









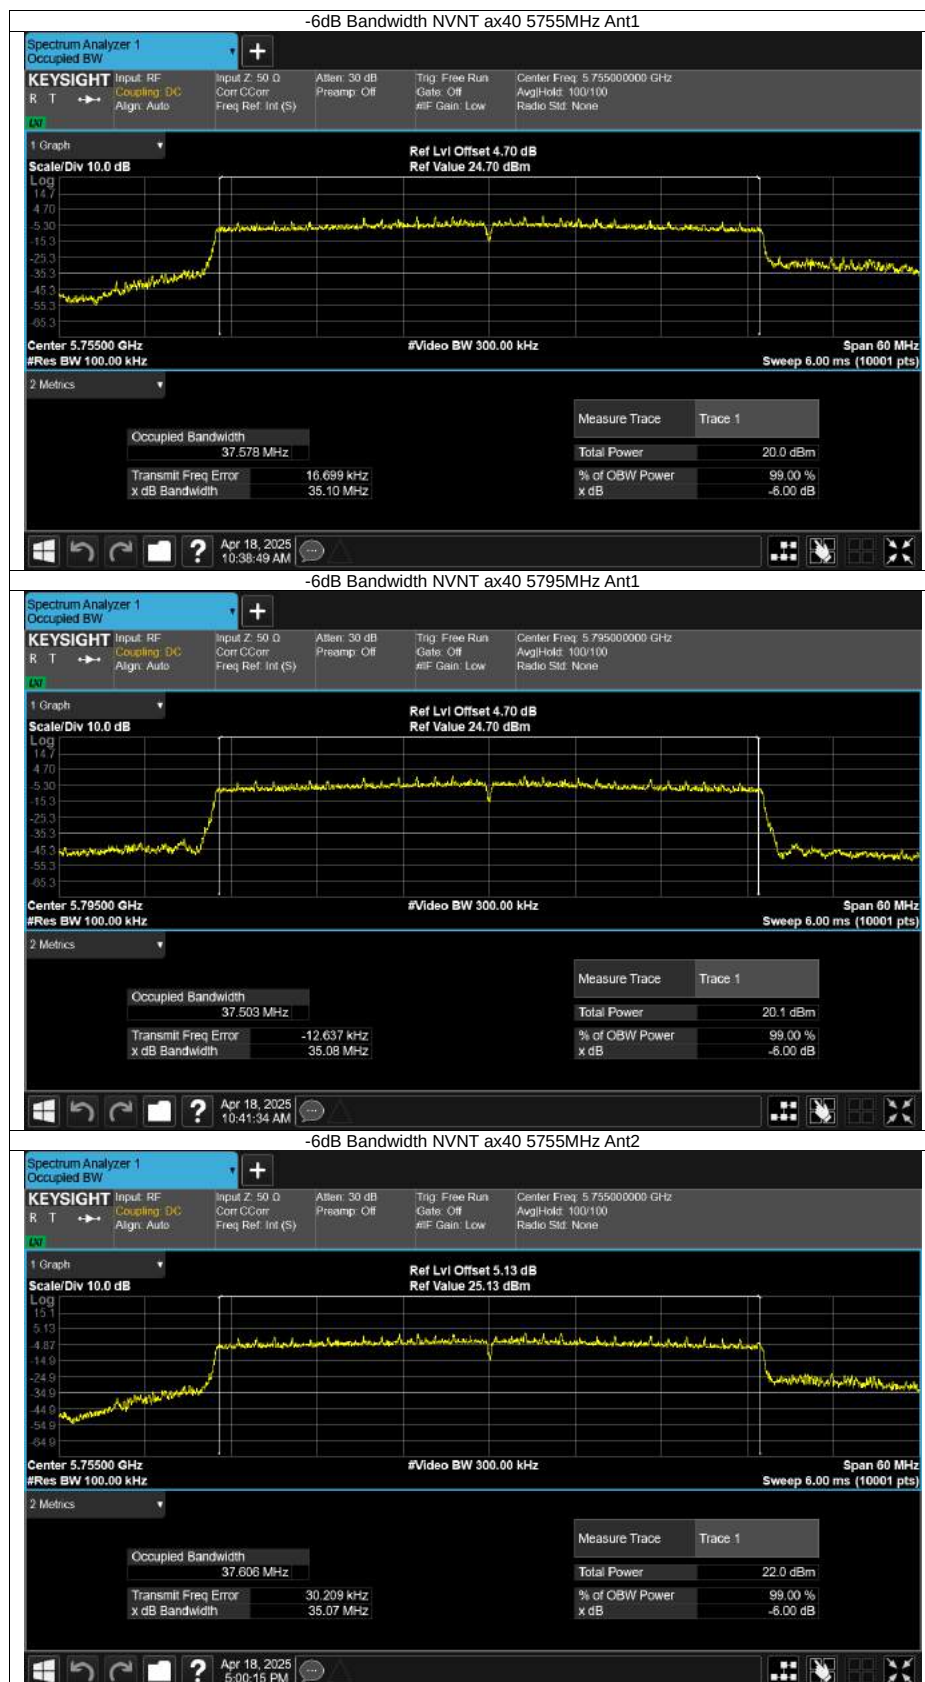

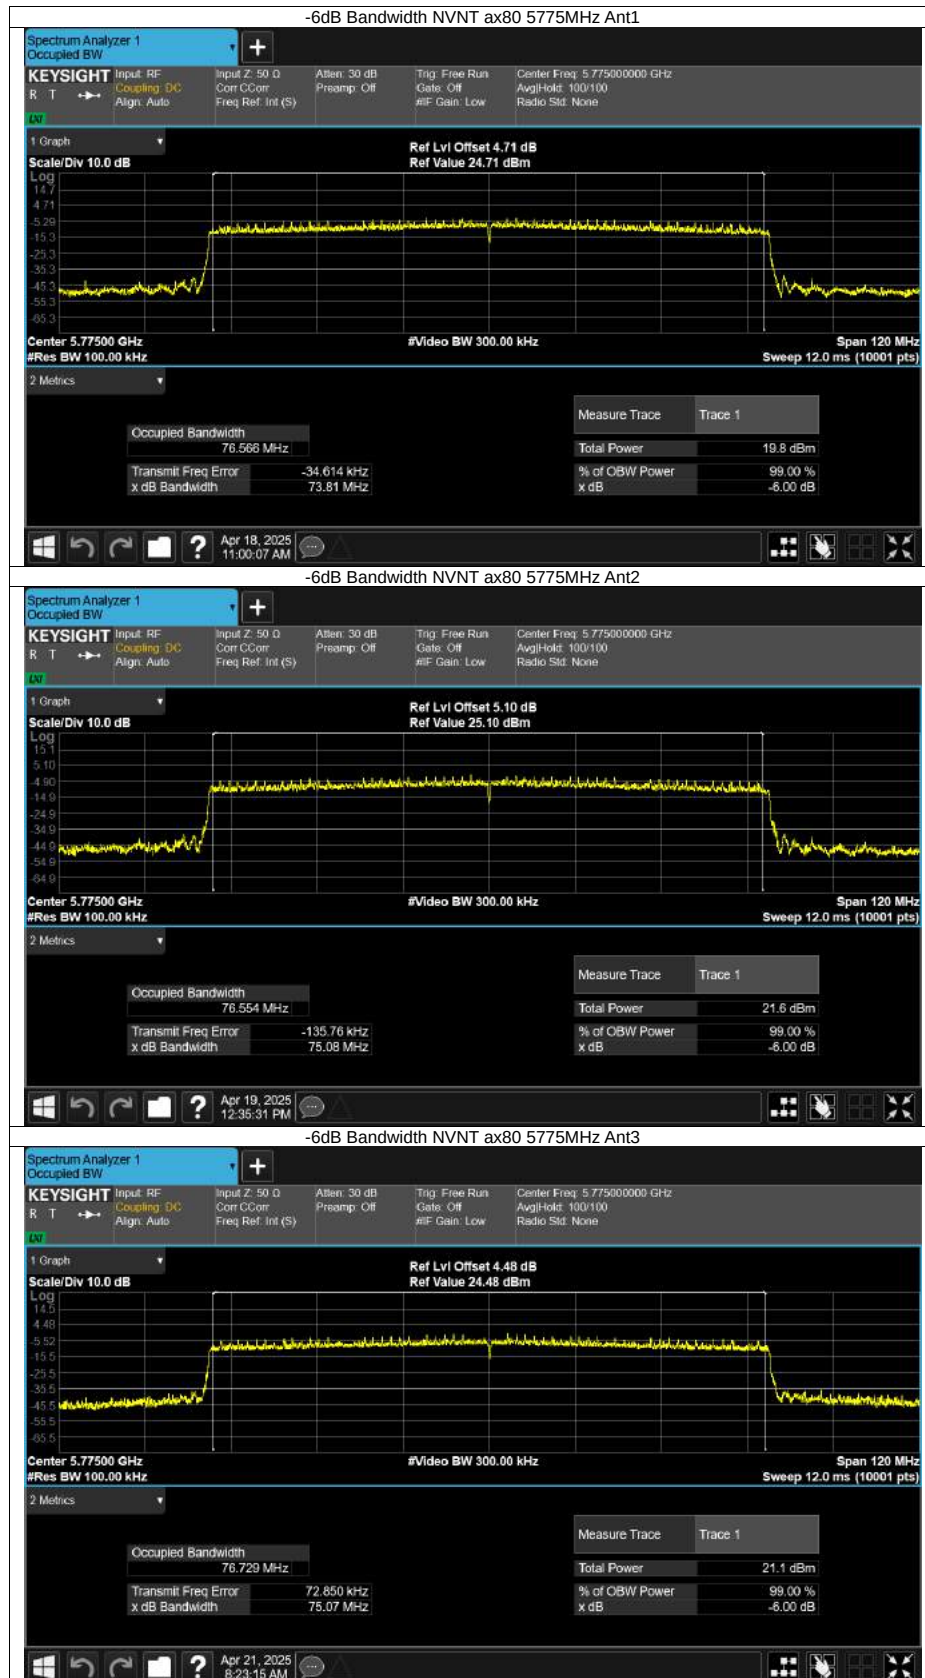



Maximum Power Spectral Density Level

Condition	Mode	Frequency (MHz)	Antenna	Conducted PSD (dBm/MHz)	Duty Factor (dB)	Total PSD (dBm/MHz)	Limit (dBm/MHz)	Verdict
NVNT	a	5180	Ant1	6.26	0.17	6.43	11	Pass
NVNT	a	5200	Ant1	6.01	0.17	6.18	11	Pass
NVNT	a	5240	Ant1	6.2	0.17	6.37	11	Pass
NVNT	a	5260	Ant1	6.99	0.17	7.16	11	Pass
NVNT	a	5300	Ant1	6.45	0.17	6.62	11	Pass
NVNT	a	5320	Ant1	5.96	0.17	6.13	11	Pass
NVNT	a	5500	Ant1	4.3	0.17	4.47	11	Pass
NVNT	a	5580	Ant1	5.37	0.17	5.54	11	Pass
NVNT	a	5700	Ant1	5.05	0.17	5.22	11	Pass
NVNT	a	5180	Ant2	6.46	0.17	6.63	11	Pass
NVNT	a	5200	Ant2	6.37	0.17	6.54	11	Pass
NVNT	a	5240	Ant2	6.34	0.17	6.51	11	Pass
NVNT	a	5260	Ant2	7.68	0.17	7.85	11	Pass
NVNT	a	5300	Ant2	7.08	0.17	7.25	11	Pass
NVNT	a	5320	Ant2	6.82	0.17	6.99	11	Pass
NVNT	a	5500	Ant2	4.59	0.17	4.76	11	Pass
NVNT	a	5580	Ant2	6.19	0.17	6.36	11	Pass
NVNT	a	5700	Ant2	5	0.17	5.17	11	Pass
NVNT	a	5180	Ant3	5.3	0.17	5.47	11	Pass
NVNT	a	5200	Ant3	5.22	0.17	5.39	11	Pass
NVNT	a	5240	Ant3	5.27	0.17	5.44	11	Pass
NVNT	a	5260	Ant3	6.72	0.17	6.89	11	Pass
NVNT	a	5300	Ant3	6.37	0.17	6.54	11	Pass
NVNT	a	5320	Ant3	6	0.17	6.17	11	Pass
NVNT	a	5500	Ant3	4.57	0.17	4.74	11	Pass
NVNT	a	5580	Ant3	4.16	0.17	4.33	11	Pass
NVNT	a	5700	Ant3	5.07	0.17	5.24	11	Pass
NVNT	n20	5180	Ant1	4.34	0.18	4.52	11	Pass
NVNT	n20	5200	Ant1	4.34	0.19	4.53	11	Pass
NVNT	n20	5240	Ant1	4.56	0.18	4.74	11	Pass
NVNT	n20	5260	Ant1	5.42	0.19	5.61	11	Pass
NVNT	n20	5300	Ant1	4.46	0.19	4.65	11	Pass
NVNT	n20	5320	Ant1	4.51	0.19	4.7	11	Pass
NVNT	n20	5500	Ant1	2.64	0.18	2.82	11	Pass
NVNT	n20	5580	Ant1	3.43	0.18	3.61	11	Pass
NVNT	n20	5700	Ant1	3.03	0.19	3.22	11	Pass
NVNT	n20	5180	Ant2	4.41	0.18	4.59	11	Pass
NVNT	n20	5200	Ant2	4.45	0.19	4.64	11	Pass
NVNT	n20	5240	Ant2	4.29	0.19	4.48	11	Pass
NVNT	n20	5260	Ant2	5.78	0.18	5.96	11	Pass
NVNT	n20	5300	Ant2	5.32	0.18	5.5	11	Pass
NVNT	n20	5320	Ant2	5.08	0.19	5.27	11	Pass
NVNT	n20	5500	Ant2	2.64	0.18	2.82	11	Pass
NVNT	n20	5580	Ant2	4.39	0.18	4.57	11	Pass
NVNT	n20	5700	Ant2	3.21	0.18	3.39	11	Pass
NVNT	n20	5180	Ant3	3.5	0.19	3.69	11	Pass
NVNT	n20	5200	Ant3	3.53	0.18	3.71	11	Pass
NVNT	n20	5240	Ant3	3.51	0.19	3.7	11	Pass
NVNT	n20	5260	Ant3	5.21	0.19	5.4	11	Pass
NVNT	n20	5300	Ant3	4.48	0.19	4.67	11	Pass
NVNT	n20	5320	Ant3	4.32	0.18	4.5	11	Pass
NVNT	n20	5500	Ant3	2.78	0.18	2.96	11	Pass
NVNT	n20	5580	Ant3	2.32	0.18	2.5	11	Pass
NVNT	n20	5700	Ant3	3.48	0.18	3.66	11	Pass
NVNT	n20	5180	Ant1	-0.34	0.1	-0.24	11	Pass
NVNT	n20	5180	Ant2	0.23	0.1	0.33	11	Pass
NVNT	n20	5180	Ant3	-1.06	0.1	-0.96	11	Pass
NVNT	n20	5180	MIMO	4.41	0.1	4.51	7.54	Pass
NVNT	n20	5200	Ant1	-0.19	0.1	-0.09	11	Pass
NVNT	n20	5200	Ant2	0.13	0.1	0.23	11	Pass
NVNT	n20	5200	Ant3	-1.21	0.1	-1.11	11	Pass
NVNT	n20	5200	MIMO	4.38	0.1	4.48	7.54	Pass
NVNT	n20	5240	Ant1	-0.23	0.1	-0.13	11	Pass
NVNT	n20	5240	Ant2	0.48	0.1	0.58	11	Pass
NVNT	n20	5240	Ant3	-0.79	0.1	-0.69	11	Pass
NVNT	n20	5240	MIMO	4.62	0.1	4.72	7.54	Pass
NVNT	n20	5260	Ant1	0.85	0.1	0.95	11	Pass
NVNT	n20	5260	Ant2	1.13	0.1	1.23	11	Pass
NVNT	n20	5260	Ant3	0.71	0.1	0.81	11	Pass
NVNT	n20	5260	MIMO	5.67	0.1	5.77	7.54	Pass
NVNT	n20	5300	Ant1	-0.02	0.1	0.08	11	Pass
NVNT	n20	5300	Ant2	0.95	0.1	1.05	11	Pass
NVNT	n20	5300	Ant3	0.04	0.1	0.14	11	Pass
NVNT	n20	5300	MIMO	5.12	0.1	5.22	7.54	Pass
NVNT	n20	5320	Ant1	-0.39	0.1	-0.29	11	Pass
NVNT	n20	5320	Ant2	0.84	0.1	0.94	11	Pass
NVNT	n20	5320	Ant3	0.01	0.1	0.11	11	Pass
NVNT	n20	5320	MIMO	4.96	0.1	5.06	7.54	Pass
NVNT	n20	5500	Ant1	-0.71	0.09	-0.62	11	Pass
NVNT	n20	5500	Ant2	-0.74	0.09	-0.65	11	Pass
NVNT	n20	5500	Ant3	-0.71	0.09	-0.62	11	Pass
NVNT	n20	5500	MIMO	4.05	0.09	4.14	7.54	Pass
NVNT	n20	5580	Ant1	0.16	0.1	0.26	11	Pass
NVNT	n20	5580	Ant2	1.2	0.1	1.3	11	Pass
NVNT	n20	5580	Ant3	-0.69	0.1	-0.59	11	Pass
NVNT	n20	5580	MIMO	5.06	0.1	5.16	7.54	Pass
NVNT	n20	5700	Ant1	-1.16	0.1	-1.06	11	Pass
NVNT	n20	5700	Ant2	-0.78	0.1	-0.68	11	Pass



NVNT	n20	5700	Ant3	-1.37	0.1	-1.27	11	Pass
NVNT	n20	5700	MIMO	3.67	0.1	3.77	7.54	Pass
NVNT	n40	5190	Ant1	1.1	0.36	1.46	11	Pass
NVNT	n40	5230	Ant1	1.41	0.36	1.77	11	Pass
NVNT	n40	5270	Ant1	1.51	0.36	1.87	11	Pass
NVNT	n40	5310	Ant1	1.58	0.37	1.95	11	Pass
NVNT	n40	5510	Ant1	-1.46	0.37	-1.09	11	Pass
NVNT	n40	5550	Ant1	-0.84	0.37	-0.47	11	Pass
NVNT	n40	5670	Ant1	-0.04	0.37	0.33	11	Pass
NVNT	n40	5190	Ant2	0.88	0.37	1.25	11	Pass
NVNT	n40	5230	Ant2	1.45	0.37	1.82	11	Pass
NVNT	n40	5270	Ant2	2.26	0.37	2.63	11	Pass
NVNT	n40	5310	Ant2	2.07	0.37	2.44	11	Pass
NVNT	n40	5510	Ant2	-1.11	0.36	-0.75	11	Pass
NVNT	n40	5550	Ant2	-0.84	0.37	-0.47	11	Pass
NVNT	n40	5670	Ant2	0.24	0.37	0.61	11	Pass
NVNT	n40	5190	Ant3	0.36	0.36	0.72	11	Pass
NVNT	n40	5230	Ant3	0.4	0.37	0.77	11	Pass
NVNT	n40	5270	Ant3	1.76	0.37	2.13	11	Pass
NVNT	n40	5310	Ant3	1.23	0.37	1.6	11	Pass
NVNT	n40	5510	Ant3	-1	0.37	-0.63	11	Pass
NVNT	n40	5550	Ant3	-0.55	0.36	-0.19	11	Pass
NVNT	n40	5670	Ant3	-1.12	0.37	-0.75	11	Pass
NVNT	n40	5190	Ant1	-3.51	0.37	-3.14	11	Pass
NVNT	n40	5190	Ant2	-2.65	0.37	-2.28	11	Pass
NVNT	n40	5190	Ant3	-4.47	0.37	-4.1	11	Pass
NVNT	n40	5190	MIMO	1.29	0.37	1.66	7.54	Pass
NVNT	n40	5230	Ant1	-3.38	0.36	-3.02	11	Pass
NVNT	n40	5230	Ant2	-2.82	0.36	-2.46	11	Pass
NVNT	n40	5230	Ant3	-4.21	0.36	-3.85	11	Pass
NVNT	n40	5230	MIMO	1.34	0.36	1.7	7.54	Pass
NVNT	n40	5270	Ant1	-2.34	0.37	-1.97	11	Pass
NVNT	n40	5270	Ant2	-2.69	0.37	-2.32	11	Pass
NVNT	n40	5270	Ant3	-2.73	0.37	-2.36	11	Pass
NVNT	n40	5270	MIMO	2.19	0.37	2.56	7.54	Pass
NVNT	n40	5310	Ant1	-3.45	0.37	-3.08	11	Pass
NVNT	n40	5310	Ant2	-2.12	0.37	-1.75	11	Pass
NVNT	n40	5310	Ant3	-3.53	0.37	-3.16	11	Pass
NVNT	n40	5310	MIMO	1.79	0.37	2.16	7.54	Pass
NVNT	n40	5510	Ant1	-5.47	0.36	-5.11	11	Pass
NVNT	n40	5510	Ant2	-5.51	0.36	-5.15	11	Pass
NVNT	n40	5510	Ant3	-5.7	0.36	-5.34	11	Pass
NVNT	n40	5510	MIMO	-0.79	0.36	-0.43	7.54	Pass
NVNT	n40	5550	Ant1	-5.4	0.37	-5.03	11	Pass
NVNT	n40	5550	Ant2	-5.89	0.37	-5.52	11	Pass
NVNT	n40	5550	Ant3	-5.41	0.37	-5.04	11	Pass
NVNT	n40	5550	MIMO	-0.79	0.37	-0.42	7.54	Pass
NVNT	n40	5670	Ant1	-4.39	0.37	-4.02	11	Pass
NVNT	n40	5670	Ant2	-3.81	0.37	-3.44	11	Pass
NVNT	n40	5670	Ant3	-5.72	0.37	-5.35	11	Pass
NVNT	n40	5670	MIMO	0.2	0.37	0.57	7.54	Pass
NVNT	ac20	5180	Ant1	4.37	0.48	4.85	11	Pass
NVNT	ac20	5200	Ant1	4.18	0.49	4.67	11	Pass
NVNT	ac20	5240	Ant1	4.4	0.49	4.89	11	Pass
NVNT	ac20	5260	Ant1	4.94	0.49	5.43	11	Pass
NVNT	ac20	5300	Ant1	4.36	0.49	4.85	11	Pass
NVNT	ac20	5320	Ant1	4.09	0.49	4.58	11	Pass
NVNT	ac20	5500	Ant1	2.3	0.48	2.78	11	Pass
NVNT	ac20	5580	Ant1	3.07	0.49	3.56	11	Pass
NVNT	ac20	5700	Ant1	2.95	0.49	3.44	11	Pass
NVNT	ac20	5180	Ant2	4.39	0.48	4.87	11	Pass
NVNT	ac20	5200	Ant2	4.2	0.48	4.68	11	Pass
NVNT	ac20	5240	Ant2	4.32	0.49	4.81	11	Pass
NVNT	ac20	5260	Ant2	5.95	0.49	6.44	11	Pass
NVNT	ac20	5300	Ant2	5.45	0.49	5.94	11	Pass
NVNT	ac20	5320	Ant2	5.33	0.48	5.81	11	Pass
NVNT	ac20	5500	Ant2	2.4	0.49	2.89	11	Pass
NVNT	ac20	5580	Ant2	4.6	0.48	5.08	11	Pass
NVNT	ac20	5700	Ant2	3.26	0.49	3.75	11	Pass
NVNT	ac20	5180	Ant3	3.72	0.49	4.21	11	Pass
NVNT	ac20	5200	Ant3	3.76	0.49	4.25	11	Pass
NVNT	ac20	5240	Ant3	3.77	0.49	4.26	11	Pass
NVNT	ac20	5260	Ant3	5.47	0.49	5.96	11	Pass
NVNT	ac20	5300	Ant3	4.8	0.48	5.28	11	Pass
NVNT	ac20	5320	Ant3	4.55	0.48	5.03	11	Pass
NVNT	ac20	5500	Ant3	3.28	0.48	3.76	11	Pass
NVNT	ac20	5580	Ant3	2.61	0.49	3.1	11	Pass
NVNT	ac20	5700	Ant3	3.57	0.49	4.06	11	Pass
NVNT	ac20	5180	Ant1	-0.43	0.48	0.05	11	Pass
NVNT	ac20	5180	Ant2	-0.16	0.48	0.32	11	Pass
NVNT	ac20	5180	Ant3	-0.93	0.48	-0.45	11	Pass
NVNT	ac20	5180	MIMO	4.28	0.48	4.76	7.54	Pass
NVNT	ac20	5200	Ant1	-0.56	0.49	-0.07	11	Pass
NVNT	ac20	5200	Ant2	0.15	0.49	0.64	11	Pass
NVNT	ac20	5200	Ant3	-1.28	0.49	-0.79	11	Pass
NVNT	ac20	5200	MIMO	4.25	0.49	4.74	7.54	Pass
NVNT	ac20	5240	Ant1	-0.8	0.49	-0.31	11	Pass
NVNT	ac20	5240	Ant2	0.45	0.49	0.94	11	Pass
NVNT	ac20	5240	Ant3	-1.35	0.49	-0.86	11	Pass
NVNT	ac20	5240	MIMO	4.27	0.49	4.76	7.54	Pass
NVNT	ac20	5260	Ant1	0.51	0.49	1	11	Pass
NVNT	ac20	5260	Ant2	1.22	0.49	1.71	11	Pass
NVNT	ac20	5260	Ant3	0.48	0.49	0.97	11	Pass
NVNT	ac20	5260	MIMO	5.52	0.49	6.01	7.54	Pass



NVNT	ac20	5300	Ant1	-0.37	0.48	0.11	11	Pass
NVNT	ac20	5300	Ant2	0.31	0.48	0.79	11	Pass
NVNT	ac20	5300	Ant3	-0.25	0.48	0.23	11	Pass
NVNT	ac20	5300	MIMO	4.68	0.48	5.16	7.54	Pass
NVNT	ac20	5320	Ant1	-0.72	0.48	-0.24	11	Pass
NVNT	ac20	5320	Ant2	0.4	0.48	0.88	11	Pass
NVNT	ac20	5320	Ant3	-0.3	0.48	0.18	11	Pass
NVNT	ac20	5320	MIMO	4.59	0.48	5.07	7.54	Pass
NVNT	ac20	5500	Ant1	-2.28	0.49	-1.79	11	Pass
NVNT	ac20	5500	Ant2	-1.91	0.49	-1.42	11	Pass
NVNT	ac20	5500	Ant3	-2.22	0.49	-1.73	11	Pass
NVNT	ac20	5500	MIMO	2.64	0.49	3.13	7.54	Pass
NVNT	ac20	5580	Ant1	-1.14	0.48	-0.66	11	Pass
NVNT	ac20	5580	Ant2	0.08	0.48	0.56	11	Pass
NVNT	ac20	5580	Ant3	-2.41	0.48	-1.93	11	Pass
NVNT	ac20	5580	MIMO	3.73	0.48	4.21	7.54	Pass
NVNT	ac20	5700	Ant1	-1.02	0.48	-0.54	11	Pass
NVNT	ac20	5700	Ant2	-1.46	0.48	-0.98	11	Pass
NVNT	ac20	5700	Ant3	-1.56	0.48	-1.08	11	Pass
NVNT	ac20	5700	MIMO	3.43	0.48	3.91	7.54	Pass
NVNT	ac40	5190	Ant1	0.81	0.84	1.65	11	Pass
NVNT	ac40	5230	Ant1	0.75	0.84	1.59	11	Pass
NVNT	ac40	5270	Ant1	1.34	0.84	2.18	11	Pass
NVNT	ac40	5310	Ant1	0.73	0.86	1.59	11	Pass
NVNT	ac40	5510	Ant1	-1.75	0.84	-0.91	11	Pass
NVNT	ac40	5550	Ant1	-1.5	0.86	-0.64	11	Pass
NVNT	ac40	5670	Ant1	-0.48	0.84	0.36	11	Pass
NVNT	ac40	5190	Ant2	1.3	0.84	2.14	11	Pass
NVNT	ac40	5230	Ant2	0.99	0.86	1.85	11	Pass
NVNT	ac40	5270	Ant2	1.98	0.86	2.84	11	Pass
NVNT	ac40	5310	Ant2	1.92	0.84	2.76	11	Pass
NVNT	ac40	5510	Ant2	-1.71	0.86	-0.85	11	Pass
NVNT	ac40	5550	Ant2	-1.05	0.86	-0.19	11	Pass
NVNT	ac40	5670	Ant2	0.25	0.84	1.09	11	Pass
NVNT	ac40	5190	Ant3	0.28	0.84	1.12	11	Pass
NVNT	ac40	5230	Ant3	0.3	0.86	1.16	11	Pass
NVNT	ac40	5270	Ant3	1.74	0.86	2.6	11	Pass
NVNT	ac40	5310	Ant3	1.2	0.84	2.04	11	Pass
NVNT	ac40	5510	Ant3	-0.86	0.86	0	11	Pass
NVNT	ac40	5550	Ant3	-0.94	0.86	-0.08	11	Pass
NVNT	ac40	5670	Ant3	-1.43	0.86	-0.57	11	Pass
NVNT	ac40	5190	Ant1	-3.73	0.86	-2.87	11	Pass
NVNT	ac40	5190	Ant2	-2.97	0.86	-2.11	11	Pass
NVNT	ac40	5190	Ant3	-4.78	0.86	-3.92	11	Pass
NVNT	ac40	5190	MIMO	1.01	0.86	1.87	7.54	Pass
NVNT	ac40	5230	Ant1	-3.82	0.86	-2.96	11	Pass
NVNT	ac40	5230	Ant2	-3.16	0.86	-2.3	11	Pass
NVNT	ac40	5230	Ant3	-4.83	0.86	-3.97	11	Pass
NVNT	ac40	5230	MIMO	0.89	0.86	1.75	7.54	Pass
NVNT	ac40	5270	Ant1	-3.28	0.86	-2.42	11	Pass
NVNT	ac40	5270	Ant2	-2.59	0.86	-1.73	11	Pass
NVNT	ac40	5270	Ant3	-2.91	0.86	-2.05	11	Pass
NVNT	ac40	5270	MIMO	1.85	0.86	2.71	7.54	Pass
NVNT	ac40	5310	Ant1	-3.8	0.86	-2.94	11	Pass
NVNT	ac40	5310	Ant2	-2.56	0.86	-1.7	11	Pass
NVNT	ac40	5310	Ant3	-3.8	0.86	-2.94	11	Pass
NVNT	ac40	5310	MIMO	1.43	0.86	2.29	7.54	Pass
NVNT	ac40	5510	Ant1	-6.13	0.85	-5.28	11	Pass
NVNT	ac40	5510	Ant2	-6.05	0.85	-5.2	11	Pass
NVNT	ac40	5510	Ant3	-6.08	0.85	-5.23	11	Pass
NVNT	ac40	5510	MIMO	-1.32	0.85	-0.47	7.54	Pass
NVNT	ac40	5550	Ant1	-6.02	0.86	-5.16	11	Pass
NVNT	ac40	5550	Ant2	-6.3	0.86	-5.44	11	Pass
NVNT	ac40	5550	Ant3	-5.87	0.86	-5.01	11	Pass
NVNT	ac40	5550	MIMO	-1.29	0.86	-0.43	7.54	Pass
NVNT	ac40	5670	Ant1	-4.76	0.86	-3.9	11	Pass
NVNT	ac40	5670	Ant2	-4.44	0.86	-3.58	11	Pass
NVNT	ac40	5670	Ant3	-6.58	0.86	-5.72	11	Pass
NVNT	ac40	5670	MIMO	-0.39	0.86	0.47	7.54	Pass
NVNT	ac80	5210	Ant1	-2.73	1.39	-1.34	11	Pass
NVNT	ac80	5290	Ant1	-2.64	1.39	-1.25	11	Pass
NVNT	ac80	5530	Ant1	-5.05	1.39	-3.66	11	Pass
NVNT	ac80	5610	Ant1	-4.43	1.39	-3.04	11	Pass
NVNT	ac80	5210	Ant2	-2.83	1.39	-1.44	11	Pass
NVNT	ac80	5290	Ant2	-1.26	1.39	0.13	11	Pass
NVNT	ac80	5530	Ant2	-5.13	1.39	-3.74	11	Pass
NVNT	ac80	5610	Ant2	-2.71	1.39	-1.32	11	Pass
NVNT	ac80	5210	Ant3	-3.06	1.39	-1.67	11	Pass
NVNT	ac80	5290	Ant3	-2.46	1.39	-1.07	11	Pass
NVNT	ac80	5530	Ant3	-4.65	1.39	-3.26	11	Pass
NVNT	ac80	5610	Ant3	-5.2	1.39	-3.81	11	Pass
NVNT	ac80	5210	Ant1	-6.7	1.39	-5.31	11	Pass
NVNT	ac80	5210	Ant2	-6.6	1.39	-5.21	11	Pass
NVNT	ac80	5210	Ant3	-8.4	1.39	-7.01	11	Pass
NVNT	ac80	5210	MIMO	-2.39	1.39	-1	7.54	Pass
NVNT	ac80	5290	Ant1	-6.65	1.39	-5.26	11	Pass
NVNT	ac80	5290	Ant2	-6.73	1.39	-5.34	11	Pass
NVNT	ac80	5290	Ant3	-7.35	1.39	-5.96	11	Pass
NVNT	ac80	5290	MIMO	-2.13	1.39	-0.74	7.54	Pass
NVNT	ac80	5530	Ant1	-11.09	1.39	-9.7	11	Pass
NVNT	ac80	5530	Ant2	-9.12	1.39	-7.73	11	Pass
NVNT	ac80	5530	Ant3	-9.99	1.39	-8.6	11	Pass
NVNT	ac80	5530	MIMO	-5.22	1.39	-3.83	7.54	Pass
NVNT	ac80	5610	Ant1	-8.74	1.39	-7.35	11	Pass



NVNT	ac80	5610	Ant2	-7.38	1.39	-5.99	11	Pass
NVNT	ac80	5610	Ant3	-9.85	1.39	-8.46	11	Pass
NVNT	ac80	5610	MIMO	-3.77	1.39	-2.38	7.54	Pass
NVNT	ac160	5250	Ant1	-7.11	1.79	-5.32	11	Pass
NVNT	ac160	5570	Ant1	-9.88	1.79	-8.09	11	Pass
NVNT	ac160	5250	Ant2	-6.41	1.76	-4.65	11	Pass
NVNT	ac160	5570	Ant2	-9.35	1.75	-7.6	11	Pass
NVNT	ac160	5250	Ant3	-8.09	1.76	-6.33	11	Pass
NVNT	ac160	5570	Ant3	-8.53	1.75	-6.78	11	Pass
NVNT	ac160	5250	Ant1	-13.81	1.76	-12.05	11	Pass
NVNT	ac160	5250	Ant2	-10.83	1.76	-9.07	11	Pass
NVNT	ac160	5250	Ant3	-12.87	1.76	-11.11	11	Pass
NVNT	ac160	5250	MIMO	-7.55	1.76	-5.79	7.54	Pass
NVNT	ac160	5570	Ant1	-13.84	1.75	-12.09	11	Pass
NVNT	ac160	5570	Ant2	-13.74	1.75	-11.99	11	Pass
NVNT	ac160	5570	Ant3	-13.71	1.75	-11.96	11	Pass
NVNT	ac160	5570	MIMO	-8.99	1.75	-7.24	7.54	Pass
NVNT	ax20	5180	Ant1	3.93	0.53	4.46	11	Pass
NVNT	ax20	5200	Ant1	3.73	0.54	4.27	11	Pass
NVNT	ax20	5240	Ant1	4.23	0.53	4.76	11	Pass
NVNT	ax20	5260	Ant1	4.71	0.54	5.25	11	Pass
NVNT	ax20	5300	Ant1	4.01	0.53	4.54	11	Pass
NVNT	ax20	5320	Ant1	4	0.53	4.53	11	Pass
NVNT	ax20	5500	Ant1	2.13	0.54	2.67	11	Pass
NVNT	ax20	5580	Ant1	3.08	0.53	3.61	11	Pass
NVNT	ax20	5700	Ant1	2.85	0.54	3.39	11	Pass
NVNT	ax20	5180	Ant2	4.44	0.54	4.98	11	Pass
NVNT	ax20	5200	Ant2	4.34	0.53	4.87	11	Pass
NVNT	ax20	5240	Ant2	5.1	0.54	5.64	11	Pass
NVNT	ax20	5260	Ant2	5.4	0.53	5.93	11	Pass
NVNT	ax20	5300	Ant2	5.01	0.53	5.54	11	Pass
NVNT	ax20	5320	Ant2	4.89	0.53	5.42	11	Pass
NVNT	ax20	5500	Ant2	2.41	0.54	2.95	11	Pass
NVNT	ax20	5580	Ant2	4.59	0.53	5.12	11	Pass
NVNT	ax20	5700	Ant2	3.07	0.54	3.61	11	Pass
NVNT	ax20	5180	Ant3	3.62	0.54	4.16	11	Pass
NVNT	ax20	5200	Ant3	3.57	0.53	4.1	11	Pass
NVNT	ax20	5240	Ant3	3.74	0.53	4.27	11	Pass
NVNT	ax20	5260	Ant3	5.18	0.53	5.71	11	Pass
NVNT	ax20	5300	Ant3	4.88	0.53	5.41	11	Pass
NVNT	ax20	5320	Ant3	4.79	0.53	5.32	11	Pass
NVNT	ax20	5500	Ant3	2.86	0.54	3.4	11	Pass
NVNT	ax20	5580	Ant3	2.8	0.54	3.34	11	Pass
NVNT	ax20	5700	Ant3	3.27	0.53	3.8	11	Pass
NVNT	ax20	5180	Ant1	-0.45	0.54	0.09	11	Pass
NVNT	ax20	5180	Ant2	-0.2	0.54	0.34	11	Pass
NVNT	ax20	5180	Ant3	-1.41	0.54	-0.87	11	Pass
NVNT	ax20	5180	MIMO	4.12	0.54	4.66	7.54	Pass
NVNT	ax20	5200	Ant1	-0.64	0.54	-0.1	11	Pass
NVNT	ax20	5200	Ant2	-0.26	0.54	0.28	11	Pass
NVNT	ax20	5200	Ant3	-1.58	0.54	-1.04	11	Pass
NVNT	ax20	5200	MIMO	3.98	0.54	4.52	7.54	Pass
NVNT	ax20	5240	Ant1	-0.57	0.54	-0.03	11	Pass
NVNT	ax20	5240	Ant2	0.36	0.54	0.9	11	Pass
NVNT	ax20	5240	Ant3	-1.32	0.54	-0.78	11	Pass
NVNT	ax20	5240	MIMO	4.32	0.54	4.86	7.54	Pass
NVNT	ax20	5260	Ant1	0.42	0.53	0.95	11	Pass
NVNT	ax20	5260	Ant2	0.54	0.53	1.07	11	Pass
NVNT	ax20	5260	Ant3	0.3	0.53	0.83	11	Pass
NVNT	ax20	5260	MIMO	5.19	0.53	5.72	7.54	Pass
NVNT	ax20	5300	Ant1	-0.54	0.53	-0.01	11	Pass
NVNT	ax20	5300	Ant2	0.41	0.53	0.94	11	Pass
NVNT	ax20	5300	Ant3	-0.37	0.53	0.16	11	Pass
NVNT	ax20	5300	MIMO	4.62	0.53	5.15	7.54	Pass
NVNT	ax20	5320	Ant1	-0.74	0.53	-0.21	11	Pass
NVNT	ax20	5320	Ant2	0.54	0.53	1.07	11	Pass
NVNT	ax20	5320	Ant3	-0.52	0.53	0.01	11	Pass
NVNT	ax20	5320	MIMO	4.57	0.53	5.1	7.54	Pass
NVNT	ax20	5500	Ant1	-2.47	0.54	-1.93	11	Pass
NVNT	ax20	5500	Ant2	-2.32	0.54	-1.78	11	Pass
NVNT	ax20	5500	Ant3	-2.17	0.54	-1.63	11	Pass
NVNT	ax20	5500	MIMO	2.45	0.54	2.99	7.54	Pass
NVNT	ax20	5580	Ant1	-1.37	0.54	-0.83	11	Pass
NVNT	ax20	5580	Ant2	-0.25	0.54	0.29	11	Pass
NVNT	ax20	5580	Ant3	-2.46	0.54	-1.92	11	Pass
NVNT	ax20	5580	MIMO	3.5	0.54	4.04	7.54	Pass
NVNT	ax20	5700	Ant1	-1.6	0.53	-1.07	11	Pass
NVNT	ax20	5700	Ant2	-1.3	0.53	-0.77	11	Pass
NVNT	ax20	5700	Ant3	-1.48	0.53	-0.95	11	Pass
NVNT	ax20	5700	MIMO	3.31	0.53	3.84	7.54	Pass
NVNT	ax40	5190	Ant1	1.06	0.55	1.61	11	Pass
NVNT	ax40	5230	Ant1	1.42	0.55	1.97	11	Pass
NVNT	ax40	5270	Ant1	1.85	0.55	2.4	11	Pass
NVNT	ax40	5310	Ant1	1.02	0.55	1.57	11	Pass
NVNT	ax40	5510	Ant1	-1.55	0.55	-1	11	Pass
NVNT	ax40	5550	Ant1	-1.23	0.55	-0.68	11	Pass
NVNT	ax40	5670	Ant1	0.13	0.55	0.68	11	Pass
NVNT	ax40	5190	Ant2	1.41	0.55	1.96	11	Pass
NVNT	ax40	5230	Ant2	2.14	0.54	2.68	11	Pass
NVNT	ax40	5270	Ant2	2.6	0.55	3.15	11	Pass
NVNT	ax40	5310	Ant2	2.25	0.55	2.8	11	Pass
NVNT	ax40	5510	Ant2	-0.98	0.54	-0.44	11	Pass
NVNT	ax40	5550	Ant2	-0.87	0.55	-0.32	11	Pass
NVNT	ax40	5670	Ant2	0.77	0.54	1.31	11	Pass



NVNT	ax40	5190	Ant3	1	0.54	1.54	11	Pass
NVNT	ax40	5230	Ant3	1.24	0.54	1.78	11	Pass
NVNT	ax40	5270	Ant3	2.19	0.55	2.74	11	Pass
NVNT	ax40	5310	Ant3	2.37	0.55	2.92	11	Pass
NVNT	ax40	5510	Ant3	-0.76	0.55	-0.21	11	Pass
NVNT	ax40	5550	Ant3	0.14	0.54	0.68	11	Pass
NVNT	ax40	5670	Ant3	-0.74	0.55	-0.19	11	Pass
NVNT	ax40	5190	Ant1	-3.5	0.54	-2.96	11	Pass
NVNT	ax40	5190	Ant2	-2.95	0.54	-2.41	11	Pass
NVNT	ax40	5190	Ant3	-4.1	0.54	-3.56	11	Pass
NVNT	ax40	5190	MIMO	1.28	0.54	1.82	7.54	Pass
NVNT	ax40	5230	Ant1	-3.62	0.55	-3.07	11	Pass
NVNT	ax40	5230	Ant2	-2.9	0.55	-2.35	11	Pass
NVNT	ax40	5230	Ant3	-4.06	0.55	-3.51	11	Pass
NVNT	ax40	5230	MIMO	1.27	0.55	1.82	7.54	Pass
NVNT	ax40	5270	Ant1	-2.51	0.55	-1.96	11	Pass
NVNT	ax40	5270	Ant2	-2.45	0.55	-1.9	11	Pass
NVNT	ax40	5270	Ant3	-2.71	0.55	-2.16	11	Pass
NVNT	ax40	5270	MIMO	2.22	0.55	2.77	7.54	Pass
NVNT	ax40	5310	Ant1	-3.23	0.54	-2.69	11	Pass
NVNT	ax40	5310	Ant2	-2.71	0.54	-2.17	11	Pass
NVNT	ax40	5310	Ant3	-3.09	0.54	-2.55	11	Pass
NVNT	ax40	5310	MIMO	1.77	0.54	2.31	7.54	Pass
NVNT	ax40	5510	Ant1	-6.05	0.55	-5.5	11	Pass
NVNT	ax40	5510	Ant2	-5.54	0.55	-4.99	11	Pass
NVNT	ax40	5510	Ant3	-5.73	0.55	-5.18	11	Pass
NVNT	ax40	5510	MIMO	-1	0.55	-0.45	7.54	Pass
NVNT	ax40	5550	Ant1	-5.53	0.55	-4.98	11	Pass
NVNT	ax40	5550	Ant2	-5.95	0.55	-5.4	11	Pass
NVNT	ax40	5550	Ant3	-5.39	0.55	-4.84	11	Pass
NVNT	ax40	5550	MIMO	-0.85	0.55	-0.3	7.54	Pass
NVNT	ax40	5670	Ant1	-4.7	0.55	-4.15	11	Pass
NVNT	ax40	5670	Ant2	-3.46	0.55	-2.91	11	Pass
NVNT	ax40	5670	Ant3	-6.08	0.55	-5.53	11	Pass
NVNT	ax40	5670	MIMO	0.15	0.55	0.7	7.54	Pass
NVNT	ax80	5210	Ant1	-1.42	0.56	-0.86	11	Pass
NVNT	ax80	5290	Ant1	-1.88	0.56	-1.32	11	Pass
NVNT	ax80	5530	Ant1	-4.51	0.56	-3.95	11	Pass
NVNT	ax80	5610	Ant1	-2.74	0.56	-2.18	11	Pass
NVNT	ax80	5210	Ant2	-1.3	0.56	-0.74	11	Pass
NVNT	ax80	5290	Ant2	-0.75	0.56	-0.19	11	Pass
NVNT	ax80	5530	Ant2	-4.36	0.56	-3.8	11	Pass
NVNT	ax80	5610	Ant2	-2.07	0.56	-1.51	11	Pass
NVNT	ax80	5210	Ant3	-1.89	0.56	-1.33	11	Pass
NVNT	ax80	5290	Ant3	-1.23	0.56	-0.67	11	Pass
NVNT	ax80	5530	Ant3	-3.97	0.56	-3.41	11	Pass
NVNT	ax80	5610	Ant3	-4.1	0.56	-3.54	11	Pass
NVNT	ax80	5210	Ant1	-6.1	0.56	-5.54	11	Pass
NVNT	ax80	5210	Ant2	-5.3	0.56	-4.74	11	Pass
NVNT	ax80	5210	Ant3	-7.48	0.56	-6.92	11	Pass
NVNT	ax80	5210	MIMO	-1.43	0.56	-0.87	7.54	Pass
NVNT	ax80	5290	Ant1	-6.2	0.56	-5.64	11	Pass
NVNT	ax80	5290	Ant2	-5.8	0.56	-5.24	11	Pass
NVNT	ax80	5290	Ant3	-6.2	0.56	-5.64	11	Pass
NVNT	ax80	5290	MIMO	-1.29	0.56	-0.73	7.54	Pass
NVNT	ax80	5530	Ant1	-10	0.56	-9.44	11	Pass
NVNT	ax80	5530	Ant2	-8.46	0.56	-7.9	11	Pass
NVNT	ax80	5530	Ant3	-8.59	0.56	-8.03	11	Pass
NVNT	ax80	5530	MIMO	-4.19	0.56	-3.63	7.54	Pass
NVNT	ax80	5610	Ant1	-7.61	0.55	-7.06	11	Pass
NVNT	ax80	5610	Ant2	-6.82	0.55	-6.27	11	Pass
NVNT	ax80	5610	Ant3	-9.39	0.55	-8.84	11	Pass
NVNT	ax80	5610	MIMO	-3.04	0.55	-2.49	7.54	Pass
NVNT	ax160	5250	Ant1	-6.36	0.51	-5.85	11	Pass
NVNT	ax160	5570	Ant1	-8.86	0.51	-8.35	11	Pass
NVNT	ax160	5250	Ant2	-5.68	0.5	-5.18	11	Pass
NVNT	ax160	5570	Ant2	-8.07	0.5	-7.57	11	Pass
NVNT	ax160	5250	Ant3	-6.88	0.51	-6.37	11	Pass
NVNT	ax160	5570	Ant3	-8.01	0.51	-7.5	11	Pass
NVNT	ax160	5250	Ant1	-12.16	0.5	-11.66	11	Pass
NVNT	ax160	5250	Ant2	-9.74	0.5	-9.24	11	Pass
NVNT	ax160	5250	Ant3	-11.72	0.5	-11.22	11	Pass
NVNT	ax160	5250	MIMO	-6.3	0.5	-5.8	7.54	Pass
NVNT	ax160	5570	Ant1	-12.39	0.51	-11.88	11	Pass
NVNT	ax160	5570	Ant2	-12.59	0.51	-12.08	11	Pass
NVNT	ax160	5570	Ant3	-13.02	0.51	-12.51	11	Pass
NVNT	ax160	5570	MIMO	-7.89	0.51	-7.38	7.54	Pass



Condition	Mode	Frequency (MHz)	Antenna	Conducted PSD (dBm/510kHz)	Conducted PSD (dBm/500kHz)	Duty Factor (dB)	Total PSD (dBm/500kHz)	Limit (dBm/500kHz)	Verdict
NVNT	a	5745	Ant1	4.07	3.98	0.17	4.24	30	Pass
NVNT	a	5785	Ant1	4.78	4.69	0.17	4.95	30	Pass
NVNT	a	5825	Ant1	3.09	3.00	0.17	3.26	30	Pass
NVNT	a	5745	Ant2	4.21	4.12	0.17	4.38	30	Pass
NVNT	a	5785	Ant2	4.53	4.44	0.17	4.7	30	Pass
NVNT	a	5825	Ant2	4.13	4.04	0.17	4.3	30	Pass
NVNT	a	5745	Ant3	2.88	2.79	0.17	3.05	30	Pass
NVNT	a	5785	Ant3	3.58	3.49	0.17	3.75	30	Pass
NVNT	a	5825	Ant3	3.13	3.04	0.17	3.3	30	Pass
NVNT	n20	5745	Ant1	2.2	2.11	0.18	2.38	30	Pass
NVNT	n20	5785	Ant1	2.76	2.67	0.19	2.95	30	Pass
NVNT	n20	5825	Ant1	1.49	1.40	0.19	1.68	30	Pass
NVNT	n20	5745	Ant2	2.27	2.18	0.18	2.45	30	Pass
NVNT	n20	5785	Ant2	2.6	2.51	0.19	2.79	30	Pass
NVNT	n20	5825	Ant2	2.37	2.28	0.18	2.55	30	Pass
NVNT	n20	5745	Ant3	1.36	1.27	0.18	1.54	30	Pass
NVNT	n20	5785	Ant3	1.31	1.22	0.18	1.49	30	Pass
NVNT	n20	5825	Ant3	1.17	1.08	0.18	1.35	30	Pass
NVNT	n20	5745	Ant1	-2.49	-2.58	0.1	-2.39	30	Pass
NVNT	n20	5745	Ant2	-2.07	-2.16	0.1	-1.97	30	Pass
NVNT	n20	5745	Ant3	-3.06	-3.15	0.1	-2.96	30	Pass
NVNT	n20	5745	MIMO	2.25	2.16	0.1	2.35	26.54	Pass
NVNT	n20	5785	Ant1	-1.58	-1.67	0.1	-1.48	30	Pass
NVNT	n20	5785	Ant2	-1.78	-1.87	0.1	-1.68	30	Pass
NVNT	n20	5785	Ant3	-2.96	-3.05	0.1	-2.86	30	Pass
NVNT	n20	5785	MIMO	2.71	2.62	0.1	2.81	26.54	Pass
NVNT	n20	5825	Ant1	-3.22	-3.31	0.1	-3.12	30	Pass
NVNT	n20	5825	Ant2	-1.9	-1.99	0.1	-1.8	30	Pass
NVNT	n20	5825	Ant3	-3.16	-3.25	0.1	-3.06	30	Pass
NVNT	n20	5825	MIMO	2.06	1.97	0.1	2.16	26.54	Pass
NVNT	n40	5755	Ant1	-1.08	-1.17	0.37	-0.71	30	Pass
NVNT	n40	5795	Ant1	-0.76	-0.85	0.37	-0.39	30	Pass
NVNT	n40	5755	Ant2	-1.06	-1.15	0.36	-0.7	30	Pass
NVNT	n40	5795	Ant2	-1.08	-1.17	0.36	-0.72	30	Pass
NVNT	n40	5755	Ant3	-2.42	-2.51	0.37	-2.05	30	Pass
NVNT	n40	5795	Ant3	-1.6	-1.69	0.37	-1.23	30	Pass
NVNT	n40	5755	Ant1	-5.96	-6.05	0.37	-5.59	30	Pass
NVNT	n40	5755	Ant2	-5.2	-5.29	0.37	-4.83	30	Pass
NVNT	n40	5755	Ant3	-7.12	-7.21	0.37	-6.75	30	Pass
NVNT	n40	5755	MIMO	-1.25	-1.34	0.37	-0.88	26.54	Pass
NVNT	n40	5795	Ant1	-5.39	-5.48	0.36	-5.03	30	Pass
NVNT	n40	5795	Ant2	-5.25	-5.34	0.36	-4.89	30	Pass
NVNT	n40	5795	Ant3	-6.59	-6.68	0.36	-6.23	30	Pass



NVNT	n40	5795	MIMO	-0.93	-1.02	0.36	-0.57	26.54	Pass
NVNT	ac20	5745	Ant1	2.44	2.35	0.48	2.92	30	Pass
NVNT	ac20	5785	Ant1	2.68	2.59	0.48	3.16	30	Pass
NVNT	ac20	5825	Ant1	1.24	1.15	0.48	1.72	30	Pass
NVNT	ac20	5745	Ant2	2.2	2.11	0.49	2.69	30	Pass
NVNT	ac20	5785	Ant2	2.61	2.52	0.49	3.1	30	Pass
NVNT	ac20	5825	Ant2	2.75	2.66	0.48	3.23	30	Pass
NVNT	ac20	5745	Ant3	1.71	1.62	0.49	2.2	30	Pass
NVNT	ac20	5785	Ant3	1.71	1.62	0.48	2.19	30	Pass
NVNT	ac20	5825	Ant3	1.34	1.25	0.48	1.82	30	Pass
NVNT	ac20	5745	Ant1	-2.5	-2.59	0.49	-2.01	30	Pass
NVNT	ac20	5745	Ant2	-1.78	-1.87	0.49	-1.29	30	Pass
NVNT	ac20	5745	Ant3	-3.14	-3.23	0.49	-2.65	30	Pass
NVNT	ac20	5745	MIMO	2.33	2.24	0.49	2.82	26.54	Pass
NVNT	ac20	5785	Ant1	-2.21	-2.30	0.49	-1.72	30	Pass
NVNT	ac20	5785	Ant2	-1.85	-1.94	0.49	-1.36	30	Pass
NVNT	ac20	5785	Ant3	-3.25	-3.34	0.49	-2.76	30	Pass
NVNT	ac20	5785	MIMO	2.37	2.28	0.49	2.86	26.54	Pass
NVNT	ac20	5825	Ant1	-3.47	-3.56	0.49	-2.98	30	Pass
NVNT	ac20	5825	Ant2	-2.32	-2.41	0.49	-1.83	30	Pass
NVNT	ac20	5825	Ant3	-3.18	-3.27	0.49	-2.69	30	Pass
NVNT	ac20	5825	MIMO	1.81	1.72	0.49	2.3	26.54	Pass
NVNT	ac40	5755	Ant1	-1.9	-1.99	0.84	-1.06	30	Pass
NVNT	ac40	5795	Ant1	-1.36	-1.45	0.86	-0.5	30	Pass
NVNT	ac40	5755	Ant2	-1.59	-1.68	0.86	-0.73	30	Pass
NVNT	ac40	5795	Ant2	-1.15	-1.24	0.84	-0.31	30	Pass
NVNT	ac40	5755	Ant3	-2.6	-2.69	0.86	-1.74	30	Pass
NVNT	ac40	5795	Ant3	-2.22	-2.31	0.84	-1.38	30	Pass
NVNT	ac40	5755	Ant1	-6.71	-6.80	0.86	-5.85	30	Pass
NVNT	ac40	5755	Ant2	-5.99	-6.08	0.86	-5.13	30	Pass
NVNT	ac40	5755	Ant3	-7.68	-7.77	0.86	-6.82	30	Pass
NVNT	ac40	5755	MIMO	-1.97	-2.06	0.86	-1.11	26.54	Pass
NVNT	ac40	5795	Ant1	-6.2	-6.29	0.86	-5.34	30	Pass
NVNT	ac40	5795	Ant2	-5.05	-5.14	0.86	-4.19	30	Pass
NVNT	ac40	5795	Ant3	-7.06	-7.15	0.86	-6.2	30	Pass
NVNT	ac40	5795	MIMO	-1.25	-1.34	0.86	-0.39	26.54	Pass
NVNT	ac80	5775	Ant1	-5.05	-5.14	1.39	-3.66	30	Pass
NVNT	ac80	5775	Ant2	-5.1	-5.19	1.39	-3.71	30	Pass
NVNT	ac80	5775	Ant3	-6.22	-6.31	1.39	-4.83	30	Pass
NVNT	ac80	5775	Ant1	-9.81	-9.90	1.39	-8.42	30	Pass
NVNT	ac80	5775	Ant2	-8.9	-8.99	1.39	-7.51	30	Pass
NVNT	ac80	5775	Ant3	-11.05	-11.14	1.39	-9.66	30	Pass
NVNT	ac80	5775	MIMO	-5.06	-5.15	1.39	-3.67	26.54	Pass
NVNT	ax20	5745	Ant1	1.67	1.58	0.54	2.21	30	Pass
NVNT	ax20	5785	Ant1	2.49	2.40	0.53	3.02	30	Pass



NVNT	ax20	5825	Ant1	1.11	1.02	0.53	1.64	30	Pass
NVNT	ax20	5745	Ant2	2.19	2.10	0.54	2.73	30	Pass
NVNT	ax20	5785	Ant2	2.6	2.51	0.54	3.14	30	Pass
NVNT	ax20	5825	Ant2	2.43	2.34	0.54	2.97	30	Pass
NVNT	ax20	5745	Ant3	1.48	1.39	0.53	2.01	30	Pass
NVNT	ax20	5785	Ant3	1.64	1.55	0.54	2.18	30	Pass
NVNT	ax20	5825	Ant3	1.61	1.52	0.53	2.14	30	Pass
NVNT	ax20	5745	Ant1	-2.85	-2.94	0.53	-2.32	30	Pass
NVNT	ax20	5745	Ant2	-2.35	-2.44	0.53	-1.82	30	Pass
NVNT	ax20	5745	Ant3	-3.6	-3.69	0.53	-3.07	30	Pass
NVNT	ax20	5745	MIMO	1.87	1.78	0.53	2.4	26.54	Pass
NVNT	ax20	5785	Ant1	-2.32	-2.41	0.54	-1.78	30	Pass
NVNT	ax20	5785	Ant2	-1.79	-1.88	0.54	-1.25	30	Pass
NVNT	ax20	5785	Ant3	-3.51	-3.60	0.54	-2.97	30	Pass
NVNT	ax20	5785	MIMO	2.29	2.20	0.54	2.83	26.54	Pass
NVNT	ax20	5825	Ant1	-3.31	-3.40	0.54	-2.77	30	Pass
NVNT	ax20	5825	Ant2	-1.76	-1.85	0.54	-1.22	30	Pass
NVNT	ax20	5825	Ant3	-3.55	-3.64	0.54	-3.01	30	Pass
NVNT	ax20	5825	MIMO	1.97	1.88	0.54	2.51	26.54	Pass
NVNT	ax40	5755	Ant1	-1.2	-1.29	0.55	-0.65	30	Pass
NVNT	ax40	5795	Ant1	-0.81	-0.90	0.55	-0.26	30	Pass
NVNT	ax40	5755	Ant2	-1.01	-1.10	0.55	-0.46	30	Pass
NVNT	ax40	5795	Ant2	-0.72	-0.81	0.54	-0.18	30	Pass
NVNT	ax40	5755	Ant3	-2.07	-2.16	0.55	-1.52	30	Pass
NVNT	ax40	5795	Ant3	-1.63	-1.72	0.54	-1.09	30	Pass
NVNT	ax40	5755	Ant1	-5.78	-5.87	0.54	-5.24	30	Pass
NVNT	ax40	5755	Ant2	-5.42	-5.51	0.54	-4.88	30	Pass
NVNT	ax40	5755	Ant3	-7.09	-7.18	0.54	-6.55	30	Pass
NVNT	ax40	5755	MIMO	-1.27	-1.36	0.54	-0.73	26.54	Pass
NVNT	ax40	5795	Ant1	-5.62	-5.71	0.55	-5.07	30	Pass
NVNT	ax40	5795	Ant2	-5.32	-5.41	0.55	-4.77	30	Pass
NVNT	ax40	5795	Ant3	-6.63	-6.72	0.55	-6.08	30	Pass
NVNT	ax40	5795	MIMO	-1.05	-1.14	0.55	-0.5	26.54	Pass
NVNT	ax80	5775	Ant1	-3.9	-3.99	0.56	-3.34	30	Pass
NVNT	ax80	5775	Ant2	-3.94	-4.03	0.56	-3.38	30	Pass
NVNT	ax80	5775	Ant3	-4.68	-4.77	0.56	-4.12	30	Pass
NVNT	ax80	5775	Ant1	-9.05	-9.14	0.56	-8.49	30	Pass
NVNT	ax80	5775	Ant2	-8.49	-8.58	0.56	-7.93	30	Pass
NVNT	ax80	5775	Ant3	-10.5	-10.59	0.56	-9.94	30	Pass
NVNT	ax80	5775	MIMO	-4.5	-4.59	0.56	-3.94	26.54	Pass

Note: RB factor=PSD-10*Log(510/500)

