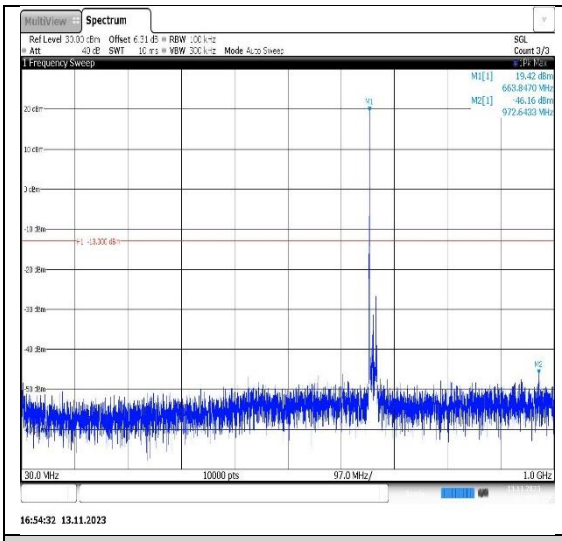

Band71-15MHz-QPSK-133297-1RB#0-Range1:30~1000MHz

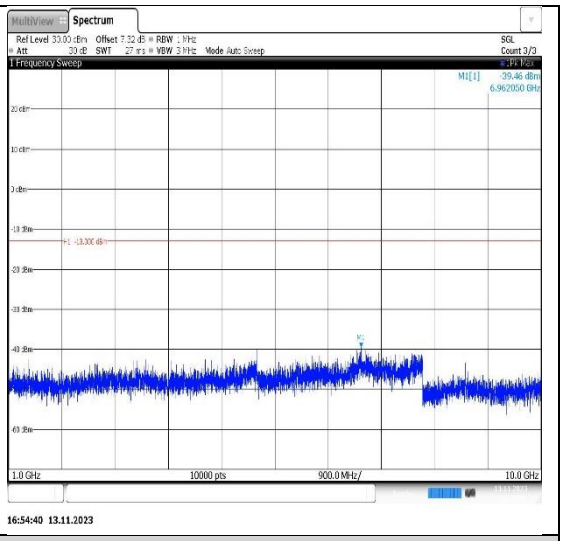

Band71-15MHz-QPSK-133297-1RB#0-Range2:1000~10000MHz

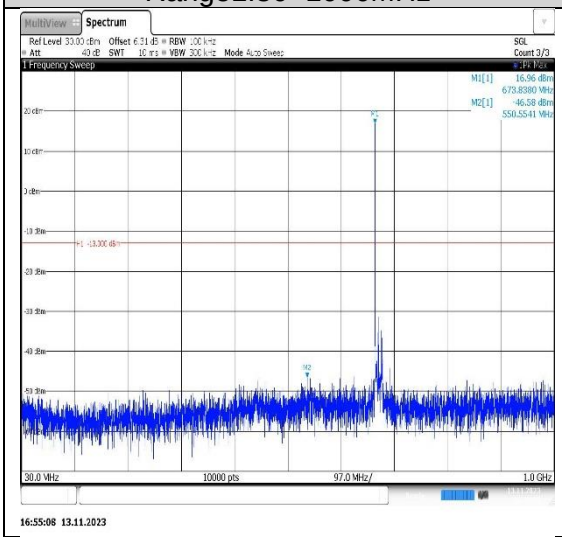

Band71-15MHz-QPSK-133397-1RB#0-Range1:30~1000MHz

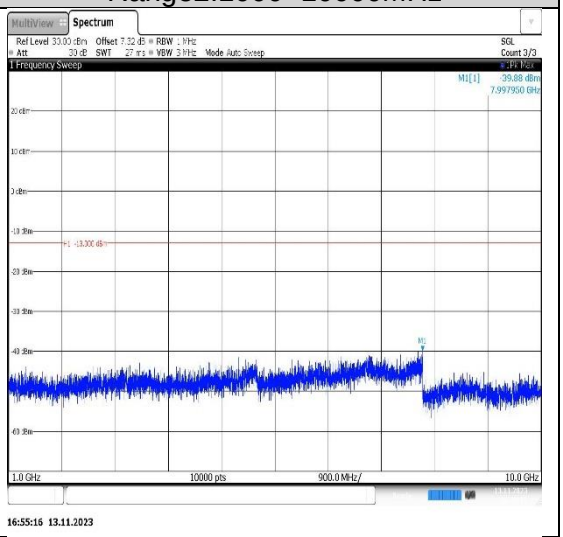

Band71-15MHz-QPSK-133397-1RB#0-Range2:1000~10000MHz

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

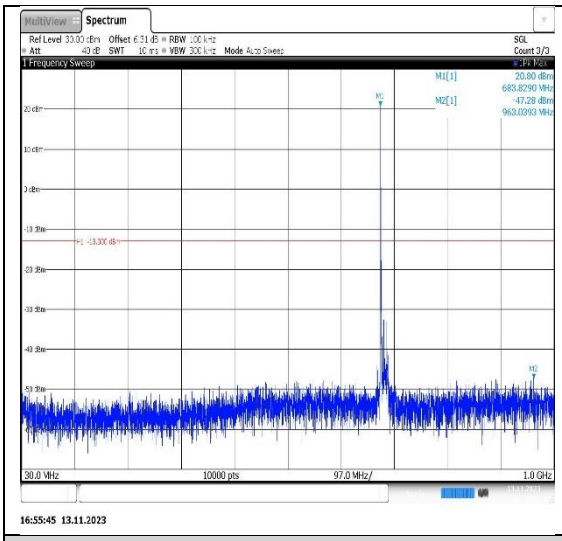

Band71-15MHz-16QAM-133197-1RB#0-Range1:30~1000MHz

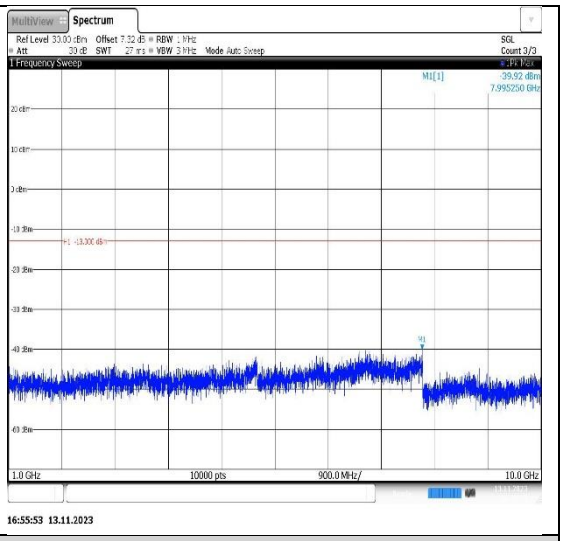

Band71-15MHz-16QAM-133197-1RB#0-Range2:1000~10000MHz

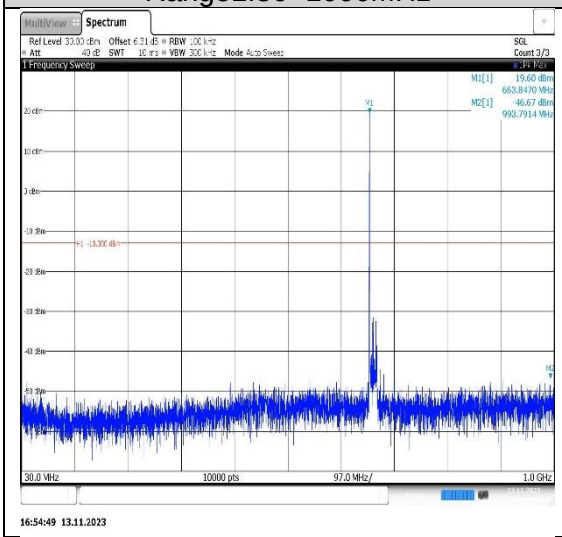

Band71-15MHz-16QAM-133297-1RB#0-Range1:30~1000MHz

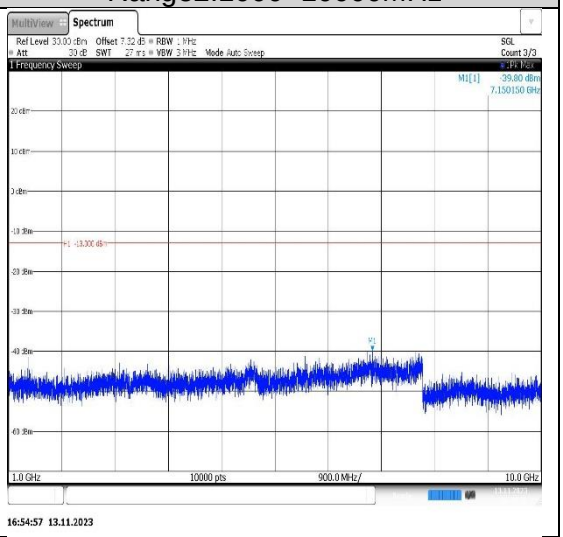

Band71-15MHz-16QAM-133297-1RB#0-Range2:1000~10000MHz

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

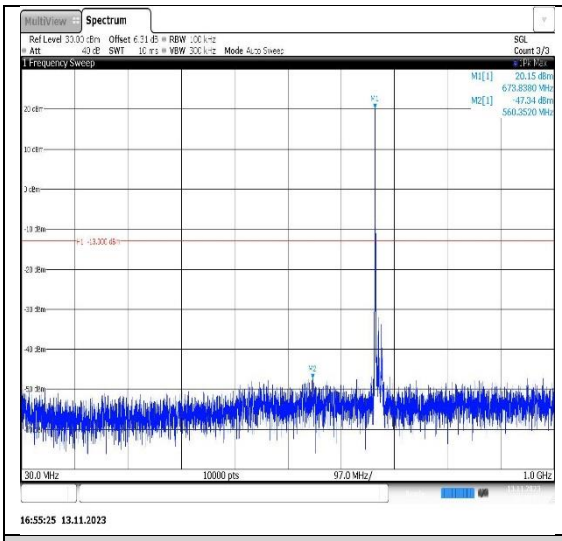

Band71-15MHz-16QAM-133397-1RB#0-Range1:30~1000MHz

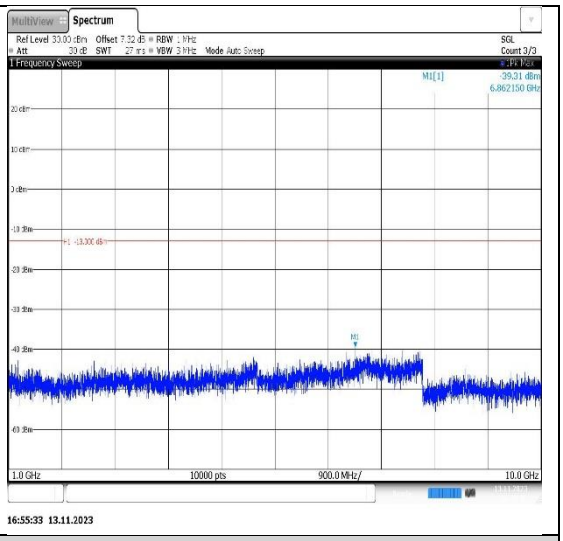

Band71-15MHz-16QAM-133397-1RB#0-Range2:1000~10000MHz

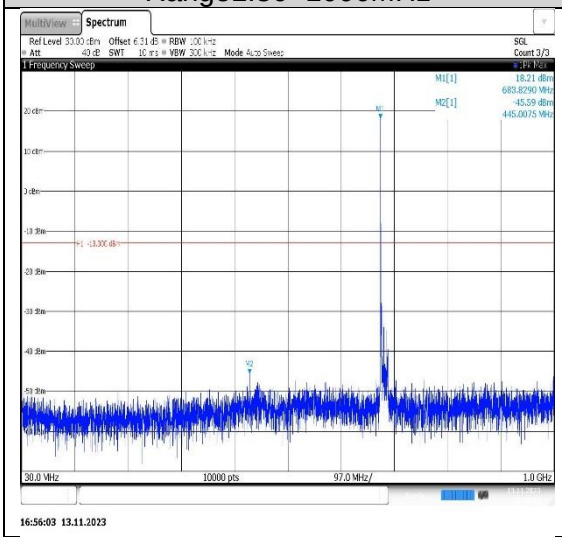

Band71-20MHz-QPSK-133222-1RB#0-Range1:30~1000MHz

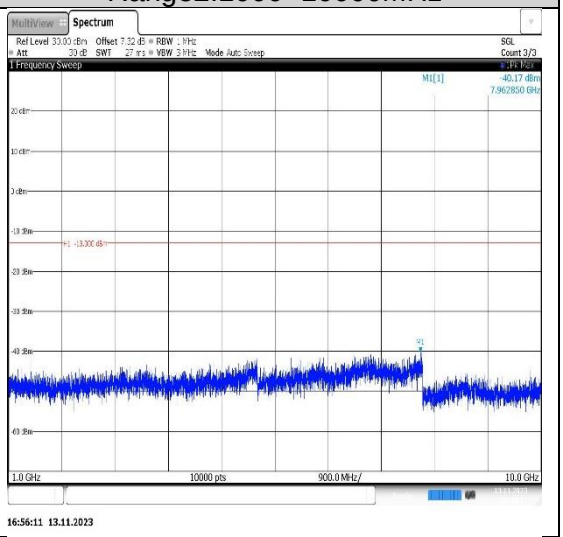

Band71-20MHz-QPSK-133222-1RB#0-Range2:1000~10000MHz

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

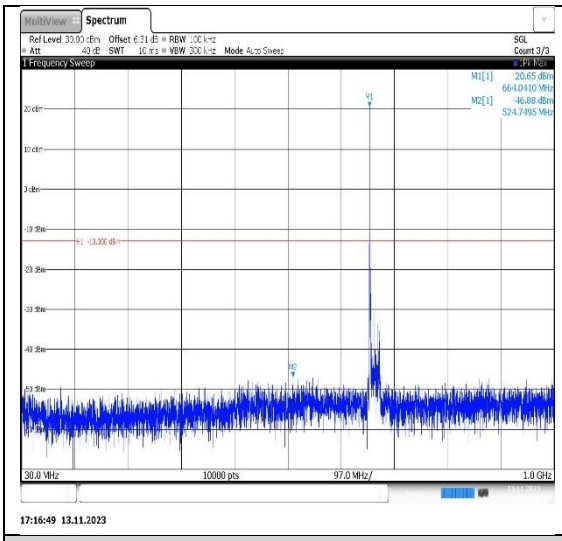

Band71-20MHz-QPSK-133322-1RB#0-Range1:30~1000MHz

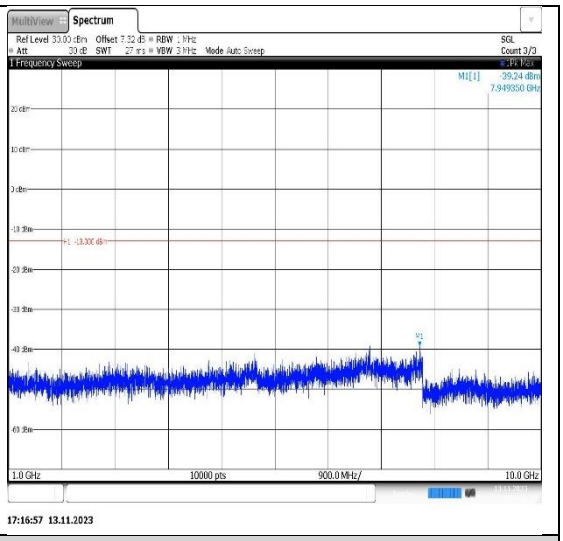

Band71-20MHz-QPSK-133322-1RB#0-Range2:1000~10000MHz

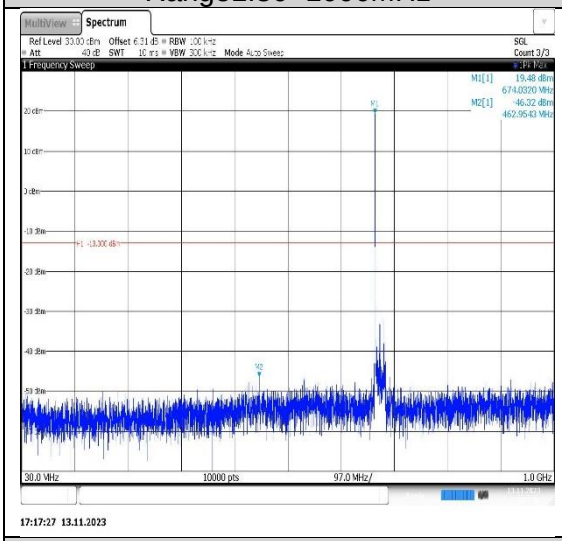

Band71-20MHz-QPSK-133372-1RB#0-Range1:30~1000MHz

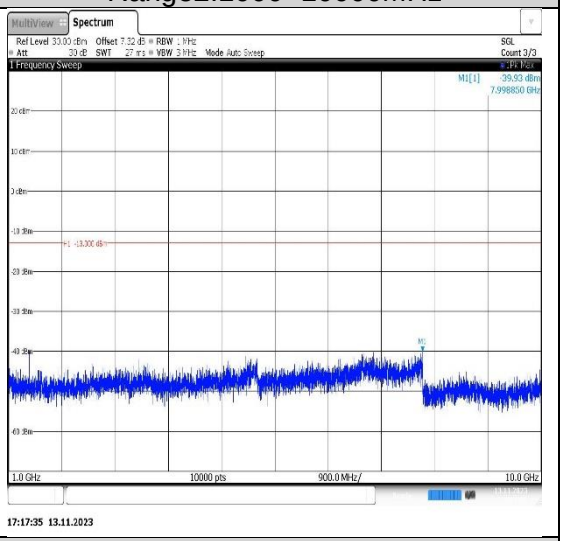

Band71-20MHz-QPSK-133372-1RB#0-Range2:1000~10000MHz

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

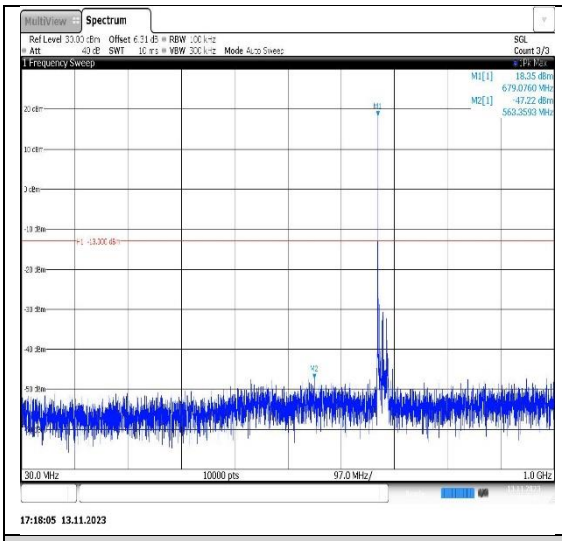

Band71-20MHz-16QAM-133222-1RB#0-Range1:30~1000MHz

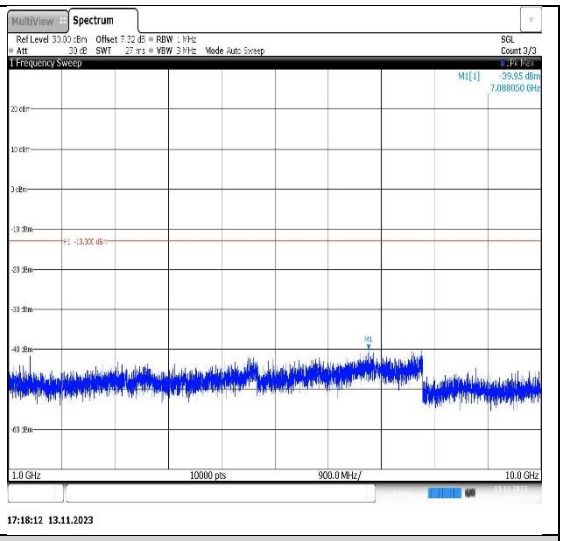

Band71-20MHz-16QAM-133222-1RB#0-Range2:1000~10000MHz

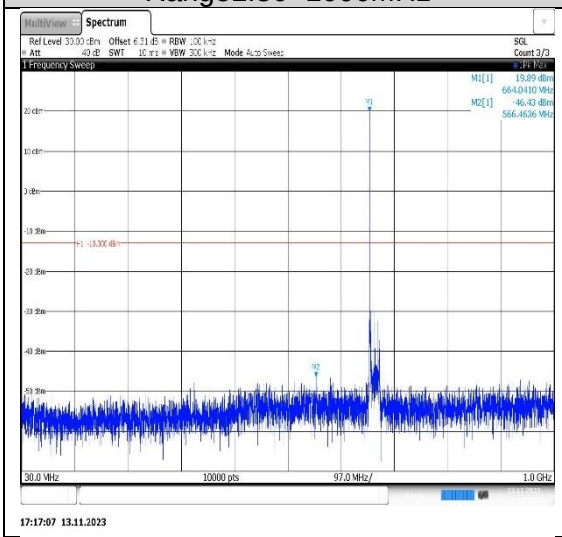

Band71-20MHz-16QAM-133322-1RB#0-Range1:30~1000MHz

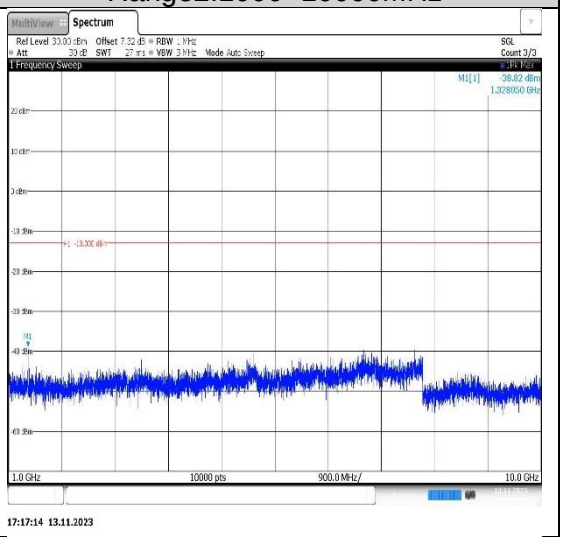

Band71-20MHz-16QAM-133322-1RB#0-Range2:1000~10000MHz

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

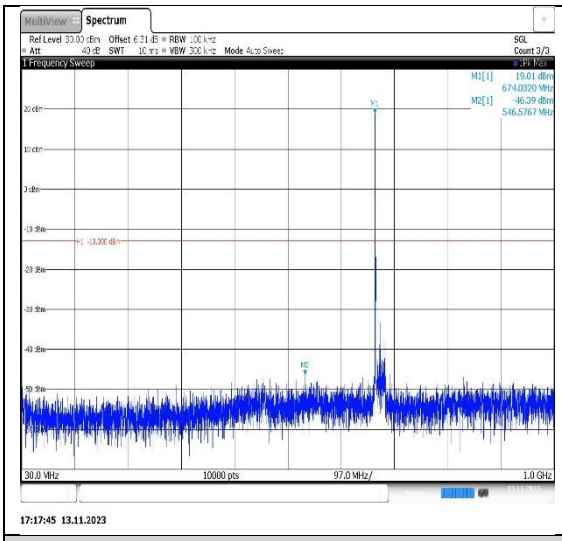

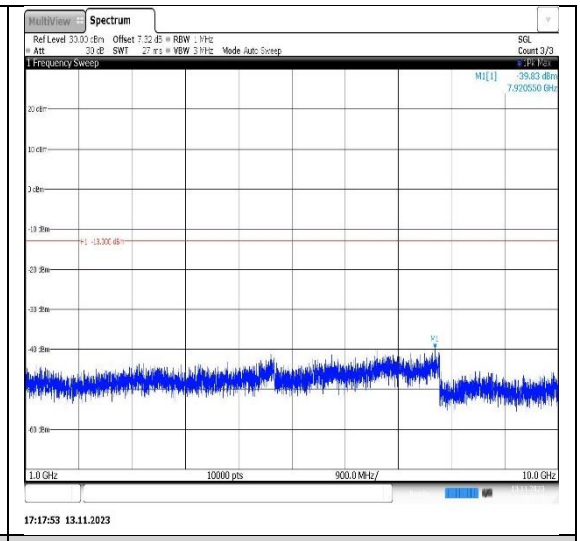

Band71-20MHz-16QAM-133372-1RB#0-Range1:30~1000MHz

Band71-20MHz-16QAM-133372-1RB#0-Range2:1000~10000MHz

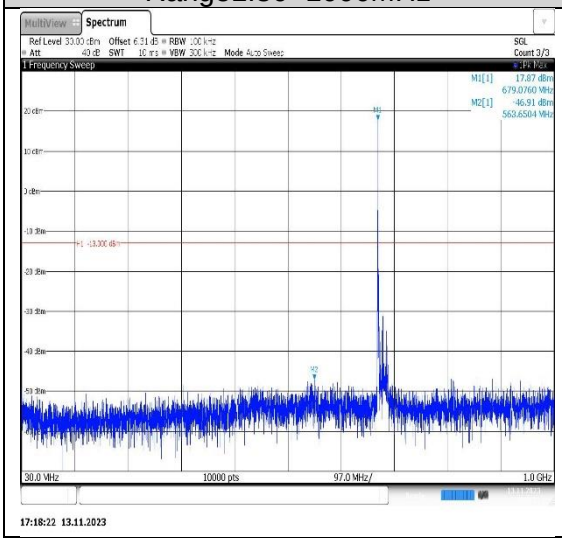

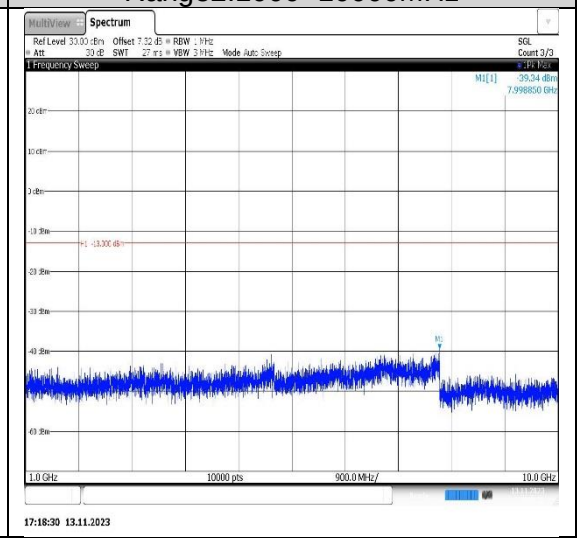

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

8.6. Appendix F: Frequency Stability

8.6.1. Test Result

Voltage										
Band	Bandwidth	Modulation	Channel	RB Configure	Voltage [Vdc]	Temperature (℃)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
Band2	1.4MHz	QPSK	18900	6RB#0	VL	NT	5.35	0.002846	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	VN	NT	8.18	0.004351	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	VH	NT	7.70	0.004096	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	VL	NT	6.51	0.003463	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	VN	NT	10.46	0.005564	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	VH	NT	5.08	0.002702	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	VL	NT	-2.96	-0.001574	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	VN	NT	6.39	0.003399	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	VH	NT	1.80	0.000957	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	VL	NT	1.85	0.000984	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	VN	NT	5.39	0.002867	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	VH	NT	4.33	0.002303	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	VL	NT	-2.89	-0.001537	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	VN	NT	-2.47	-0.001314	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	VH	NT	3.29	0.001750	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	VL	NT	7.75	0.004122	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	VN	NT	6.27	0.003335	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	VH	NT	6.07	0.003229	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	VL	NT	-2.33	-0.001345	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	VN	NT	6.11	0.003527	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	VH	NT	4.86	0.002805	±2.5	PASS
Band4	3MHz	QPSK	20175	15RB#0	VL	NT	-2.22	-0.001281	±2.5	PASS
Band4	3MHz	QPSK	20175	15RB#0	VN	NT	4.69	0.002707	±2.5	PASS
Band4	3MHz	QPSK	20175	15RB#0	VH	NT	-1.90	-0.001097	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	VL	NT	3.30	0.001905	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	VN	NT	-4.35	-0.002511	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	VH	NT	-6.32	-0.003648	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	VL	NT	6.57	0.003792	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	VN	NT	3.71	0.002141	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	VH	NT	5.79	0.003342	±2.5	PASS
Band4	15MHz	QPSK	20175	75RB#0	VL	NT	-6.32	-0.003648	±2.5	PASS
Band4	15MHz	QPSK	20175	75RB#0	VN	NT	4.61	0.002661	±2.5	PASS
Band4	15MHz	QPSK	20175	75RB#0	VH	NT	2.45	0.001414	±2.5	PASS
Band4	20MHz	QPSK	20175	100RB#0	VL	NT	-5.15	-0.002973	±2.5	PASS
Band4	20MHz	QPSK	20175	100RB#0	VN	NT	3.55	0.002049	±2.5	PASS
Band4	20MHz	QPSK	20175	100RB#0	VH	NT	2.59	0.001495	±2.5	PASS
Band5	1.4MHz	QPSK	20525	6RB#0	VL	NT	1.47	0.001757	±2.5	PASS
Band5	1.4MHz	QPSK	20525	6RB#0	VN	NT	-4.52	-0.005403	±2.5	PASS
Band5	1.4MHz	QPSK	20525	6RB#0	VH	NT	-8.14	-0.009731	±2.5	PASS
Band5	3MHz	QPSK	20525	15RB#0	VL	NT	1.14	0.001363	±2.5	PASS
Band5	3MHz	QPSK	20525	15RB#0	VN	NT	3.55	0.004244	±2.5	PASS

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

Band5	3MHz	QPSK	20525	15RB#0	VH	NT	-3.68	-0.004399	±2.5	PASS
Band5	5MHz	QPSK	20525	25RB#0	VL	NT	2.37	0.002833	±2.5	PASS
Band5	5MHz	QPSK	20525	25RB#0	VN	NT	-3.00	-0.003586	±2.5	PASS
Band5	5MHz	QPSK	20525	25RB#0	VH	NT	-4.23	-0.005057	±2.5	PASS
Band5	10MHz	QPSK	20525	50RB#0	VL	NT	-5.72	-0.006838	±2.5	PASS
Band5	10MHz	QPSK	20525	50RB#0	VN	NT	-4.01	-0.004794	±2.5	PASS
Band5	10MHz	QPSK	20525	50RB#0	VH	NT	-1.36	-0.001626	±2.5	PASS
Band7	5MHz	QPSK	20775	25RB#0	VL	NT	7.07	0.002825	±2.5	PASS
Band7	5MHz	QPSK	20775	25RB#0	VN	NT	-4.66	-0.001862	±2.5	PASS
Band7	5MHz	QPSK	20775	25RB#0	VH	NT	-4.11	-0.001642	±2.5	PASS
Band7	5MHz	QPSK	21100	25RB#0	VL	NT	5.56	0.002193	±2.5	PASS
Band7	5MHz	QPSK	21100	25RB#0	VN	NT	3.33	0.001314	±2.5	PASS
Band7	5MHz	QPSK	21100	25RB#0	VH	NT	6.41	0.002529	±2.5	PASS
Band7	5MHz	QPSK	21425	25RB#0	VL	NT	-5.32	-0.002072	±2.5	PASS
Band7	5MHz	QPSK	21425	25RB#0	VN	NT	6.18	0.002407	±2.5	PASS
Band7	5MHz	QPSK	21425	25RB#0	VH	NT	-4.99	-0.001944	±2.5	PASS
Band7	10MHz	QPSK	20800	50RB#0	VL	NT	-6.69	-0.002671	±2.5	PASS
Band7	10MHz	QPSK	20800	50RB#0	VN	NT	8.14	0.003250	±2.5	PASS
Band7	10MHz	QPSK	20800	50RB#0	VH	NT	-5.66	-0.002259	±2.5	PASS
Band7	10MHz	QPSK	21100	50RB#0	VL	NT	4.79	0.001890	±2.5	PASS
Band7	10MHz	QPSK	21100	50RB#0	VN	NT	-5.95	-0.002347	±2.5	PASS
Band7	10MHz	QPSK	21100	50RB#0	VH	NT	-5.87	-0.002316	±2.5	PASS
Band7	10MHz	QPSK	21400	50RB#0	VL	NT	5.19	0.002023	±2.5	PASS
Band7	10MHz	QPSK	21400	50RB#0	VN	NT	6.87	0.002678	±2.5	PASS
Band7	10MHz	QPSK	21400	50RB#0	VH	NT	-10.73	-0.004183	±2.5	PASS
Band7	15MHz	QPSK	20825	75RB#0	VL	NT	5.26	0.002098	±2.5	PASS
Band7	15MHz	QPSK	20825	75RB#0	VN	NT	3.85	0.001535	±2.5	PASS
Band7	15MHz	QPSK	20825	75RB#0	VH	NT	5.66	0.002257	±2.5	PASS
Band7	15MHz	QPSK	21100	75RB#0	VL	NT	10.81	0.004264	±2.5	PASS
Band7	15MHz	QPSK	21100	75RB#0	VN	NT	10.34	0.004079	±2.5	PASS
Band7	15MHz	QPSK	21100	75RB#0	VH	NT	-8.73	-0.003444	±2.5	PASS
Band7	15MHz	QPSK	21375	75RB#0	VL	NT	7.21	0.002814	±2.5	PASS
Band7	15MHz	QPSK	21375	75RB#0	VN	NT	7.14	0.002786	±2.5	PASS
Band7	15MHz	QPSK	21375	75RB#0	VH	NT	-8.04	-0.003138	±2.5	PASS
Band7	20MHz	QPSK	20850	100RB#0	VL	NT	-5.38	-0.002143	±2.5	PASS
Band7	20MHz	QPSK	20850	100RB#0	VN	NT	8.40	0.003347	±2.5	PASS
Band7	20MHz	QPSK	20850	100RB#0	VH	NT	-6.01	-0.002394	±2.5	PASS
Band7	20MHz	QPSK	21100	100RB#0	VL	NT	6.28	0.002477	±2.5	PASS
Band7	20MHz	QPSK	21100	100RB#0	VN	NT	-6.54	-0.002580	±2.5	PASS
Band7	20MHz	QPSK	21100	100RB#0	VH	NT	6.68	0.002635	±2.5	PASS
Band7	20MHz	QPSK	21350	100RB#0	VL	NT	4.35	0.001699	±2.5	PASS
Band7	20MHz	QPSK	21350	100RB#0	VN	NT	5.11	0.001996	±2.5	PASS
Band7	20MHz	QPSK	21350	100RB#0	VH	NT	8.04	0.003141	±2.5	PASS
Band12	1.4MHz	QPSK	23095	6RB#0	VL	NT	-3.72	-0.005258	±2.5	PASS
Band12	1.4MHz	QPSK	23095	6RB#0	VN	NT	2.86	0.004042	±2.5	PASS
Band12	1.4MHz	QPSK	23095	6RB#0	VH	NT	2.75	0.003887	±2.5	PASS
Band12	3MHz	QPSK	23095	15RB#0	VL	NT	-1.39	-0.001965	±2.5	PASS
Band12	3MHz	QPSK	23095	15RB#0	VN	NT	-3.12	-0.004410	±2.5	PASS

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

Band12	3MHz	QPSK	23095	15RB#0	VH	NT	2.90	0.004099	±2.5	PASS
Band12	5MHz	QPSK	23095	25RB#0	VL	NT	-2.36	-0.003336	±2.5	PASS
Band12	5MHz	QPSK	23095	25RB#0	VN	NT	-2.85	-0.004028	±2.5	PASS
Band12	5MHz	QPSK	23095	25RB#0	VH	NT	3.68	0.005201	±2.5	PASS
Band12	10MHz	QPSK	23095	50RB#0	VL	NT	-5.18	-0.007322	±2.5	PASS
Band12	10MHz	QPSK	23095	50RB#0	VN	NT	-3.10	-0.004382	±2.5	PASS
Band12	10MHz	QPSK	23095	50RB#0	VH	NT	2.99	0.004226	±2.5	PASS
Band13	5MHz	QPSK	23230	25RB#0	VL	NT	2.62	0.003350	±2.5	PASS
Band13	5MHz	QPSK	23230	25RB#0	VN	NT	-1.65	-0.002110	±2.5	PASS
Band13	5MHz	QPSK	23230	25RB#0	VH	NT	-2.65	-0.003389	±2.5	PASS
Band13	10MHz	QPSK	23230	50RB#0	VL	NT	0.00	0.000000	±2.5	PASS
Band13	10MHz	QPSK	23230	50RB#0	VN	NT	0.00	0.000000	±2.5	PASS
Band13	10MHz	QPSK	23230	50RB#0	VH	NT	0.00	0.000000	±2.5	PASS
Band25	1.4MHz	QPSK	26365	6RB#0	VL	NT	-3.82	-0.002029	±2.5	PASS
Band25	1.4MHz	QPSK	26365	6RB#0	VN	NT	3.75	0.001992	±2.5	PASS
Band25	1.4MHz	QPSK	26365	6RB#0	VH	NT	-5.41	-0.002874	±2.5	PASS
Band25	3MHz	QPSK	26365	15RB#0	VL	NT	2.68	0.001424	±2.5	PASS
Band25	3MHz	QPSK	26365	15RB#0	VN	NT	7.14	0.003793	±2.5	PASS
Band25	3MHz	QPSK	26365	15RB#0	VH	NT	6.39	0.003394	±2.5	PASS
Band25	5MHz	QPSK	26365	25RB#0	VL	NT	-2.42	-0.001286	±2.5	PASS
Band25	5MHz	QPSK	26365	25RB#0	VN	NT	8.17	0.004340	±2.5	PASS
Band25	5MHz	QPSK	26365	25RB#0	VH	NT	-4.75	-0.002523	±2.5	PASS
Band25	10MHz	QPSK	26365	50RB#0	VL	NT	-5.41	-0.002874	±2.5	PASS
Band25	10MHz	QPSK	26365	50RB#0	VN	NT	-6.97	-0.003703	±2.5	PASS
Band25	10MHz	QPSK	26365	50RB#0	VH	NT	-4.61	-0.002449	±2.5	PASS
Band25	15MHz	QPSK	26365	75RB#0	VL	NT	-7.38	-0.003920	±2.5	PASS
Band25	15MHz	QPSK	26365	75RB#0	VN	NT	5.81	0.003086	±2.5	PASS
Band25	15MHz	QPSK	26365	75RB#0	VH	NT	7.78	0.004133	±2.5	PASS
Band25	20MHz	QPSK	26365	100RB#0	VL	NT	6.22	0.003304	±2.5	PASS
Band25	20MHz	QPSK	26365	100RB#0	VN	NT	8.01	0.004255	±2.5	PASS
Band25	20MHz	QPSK	26365	100RB#0	VH	NT	8.41	0.004467	±2.5	PASS
Band26 (814-824)	1.4MHz	QPSK	26740	6RB#0	VL	NT	-1.24	-0.001514	±2.5	PASS
Band26 (814-824)	1.4MHz	QPSK	26740	6RB#0	VN	NT	-2.00	-0.002442	±2.5	PASS
Band26 (814-824)	1.4MHz	QPSK	26740	6RB#0	VH	NT	4.15	0.005067	±2.5	PASS
Band26 (814-824)	3MHz	QPSK	26740	15RB#0	VL	NT	5.72	0.006984	±2.5	PASS
Band26 (814-824)	3MHz	QPSK	26740	15RB#0	VN	NT	-2.35	-0.002869	±2.5	PASS
Band26 (814-824)	3MHz	QPSK	26740	15RB#0	VH	NT	-2.90	-0.003541	±2.5	PASS
Band26 (814-824)	5MHz	QPSK	26740	25RB#0	VL	NT	4.11	0.005018	±2.5	PASS
Band26 (814-824)	5MHz	QPSK	26740	25RB#0	VN	NT	-3.28	-0.004005	±2.5	PASS

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

Band26 (814-824)	5MHz	QPSK	26740	25RB#0	VH	NT	6.21	0.007582	±2.5	PASS
Band26 (814-824)	10MHz	QPSK	26740	50RB#0	VL	NT	0.00	0.000000	±2.5	PASS
Band26 (814-824)	10MHz	QPSK	26740	50RB#0	VN	NT	0.00	0.000000	±2.5	PASS
Band26 (814-824)	10MHz	QPSK	26740	50RB#0	VH	NT	0.00	0.000000	±2.5	PASS
Band26 (824-849)	1.4MHz	QPSK	26915	6RB#0	VL	NT	-4.03	-0.004818	±2.5	PASS
Band26 (824-849)	1.4MHz	QPSK	26915	6RB#0	VN	NT	4.01	0.004794	±2.5	PASS
Band26 (824-849)	1.4MHz	QPSK	26915	6RB#0	VH	NT	2.29	0.002738	±2.5	PASS
Band26 (824-849)	3MHz	QPSK	26915	15RB#0	VL	NT	-6.28	-0.007507	±2.5	PASS
Band26 (824-849)	3MHz	QPSK	26915	15RB#0	VN	NT	2.93	0.003503	±2.5	PASS
Band26 (824-849)	3MHz	QPSK	26915	15RB#0	VH	NT	1.06	0.001267	±2.5	PASS
Band26 (824-849)	5MHz	QPSK	26915	25RB#0	VL	NT	-5.05	-0.006037	±2.5	PASS
Band26 (824-849)	5MHz	QPSK	26915	25RB#0	VN	NT	1.99	0.002379	±2.5	PASS
Band26 (824-849)	5MHz	QPSK	26915	25RB#0	VH	NT	1.97	0.002355	±2.5	PASS
Band26 (824-849)	10MHz	QPSK	26915	50RB#0	VL	NT	-2.90	-0.003467	±2.5	PASS
Band26 (824-849)	10MHz	QPSK	26915	50RB#0	VN	NT	-3.73	-0.004459	±2.5	PASS
Band26 (824-849)	10MHz	QPSK	26915	50RB#0	VH	NT	-3.23	-0.003861	±2.5	PASS
Band26 (824-849)	15MHz	QPSK	26915	75RB#0	VL	NT	-4.65	-0.005559	±2.5	PASS
Band26 (824-849)	15MHz	QPSK	26915	75RB#0	VN	NT	-2.56	-0.003060	±2.5	PASS
Band26 (824-849)	15MHz	QPSK	26915	75RB#0	VH	NT	-2.50	-0.002989	±2.5	PASS
Band41	5MHz	QPSK	40620	25RB#0	VL	NT	-24.19	-0.009329	±2.5	PASS
Band41	5MHz	QPSK	40620	25RB#0	VN	NT	-23.02	-0.008878	±2.5	PASS
Band41	5MHz	QPSK	40620	25RB#0	VH	NT	-39.55	-0.015253	±2.5	PASS
Band41	10MHz	QPSK	40620	50RB#0	VL	NT	-4.52	-0.001743	±2.5	PASS
Band41	10MHz	QPSK	40620	50RB#0	VN	NT	-5.81	-0.002241	±2.5	PASS
Band41	10MHz	QPSK	40620	50RB#0	VH	NT	-4.88	-0.001882	±2.5	PASS
Band41	15MHz	QPSK	40620	75RB#0	VL	NT	-3.38	-0.001304	±2.5	PASS

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

Band41	15MHz	QPSK	40620	75RB#0	VN	NT	-7.91	-0.003051	±2.5	PASS
Band41	15MHz	QPSK	40620	75RB#0	VH	NT	-5.78	-0.002229	±2.5	PASS
Band41	20MHz	QPSK	40620	100RB#0	VL	NT	-6.78	-0.002615	±2.5	PASS
Band41	20MHz	QPSK	40620	100RB#0	VN	NT	4.15	0.001600	±2.5	PASS
Band41	20MHz	QPSK	40620	100RB#0	VH	NT	-8.58	-0.003309	±2.5	PASS
Band66	1.4MHz	QPSK	132322	6RB#0	VL	NT	11.16	0.006395	±2.5	PASS
Band66	1.4MHz	QPSK	132322	6RB#0	VN	NT	12.77	0.007318	±2.5	PASS
Band66	1.4MHz	QPSK	132322	6RB#0	VH	NT	8.96	0.005135	±2.5	PASS
Band66	3MHz	QPSK	132322	15RB#0	VL	NT	-3.49	-0.002000	±2.5	PASS
Band66	3MHz	QPSK	132322	15RB#0	VN	NT	8.41	0.004819	±2.5	PASS
Band66	3MHz	QPSK	132322	15RB#0	VH	NT	2.90	0.001662	±2.5	PASS
Band66	5MHz	QPSK	132322	25RB#0	VL	NT	-8.01	-0.004590	±2.5	PASS
Band66	5MHz	QPSK	132322	25RB#0	VN	NT	-4.98	-0.002854	±2.5	PASS
Band66	5MHz	QPSK	132322	25RB#0	VH	NT	7.45	0.004269	±2.5	PASS
Band66	10MHz	QPSK	132322	50RB#0	VL	NT	13.22	0.007576	±2.5	PASS
Band66	10MHz	QPSK	132322	50RB#0	VN	NT	-5.81	-0.003330	±2.5	PASS
Band66	10MHz	QPSK	132322	50RB#0	VH	NT	11.04	0.006327	±2.5	PASS
Band66	15MHz	QPSK	132322	75RB#0	VL	NT	5.71	0.003272	±2.5	PASS
Band66	15MHz	QPSK	132322	75RB#0	VN	NT	7.34	0.004206	±2.5	PASS
Band66	15MHz	QPSK	132322	75RB#0	VH	NT	-4.08	-0.002338	±2.5	PASS
Band66	20MHz	QPSK	132322	100RB#0	VL	NT	7.21	0.004132	±2.5	PASS
Band66	20MHz	QPSK	132322	100RB#0	VN	NT	-5.87	-0.003364	±2.5	PASS
Band66	20MHz	QPSK	132322	100RB#0	VH	NT	7.02	0.004023	±2.5	PASS
Band71	5MHz	QPSK	133147	25RB#0	VL	NT	3.15	0.004733	±2.5	PASS
Band71	5MHz	QPSK	133147	25RB#0	VN	NT	-4.03	-0.006056	±2.5	PASS
Band71	5MHz	QPSK	133147	25RB#0	VH	NT	-4.76	-0.007153	±2.5	PASS
Band71	5MHz	QPSK	133297	25RB#0	VL	NT	-3.55	-0.005217	±2.5	PASS
Band71	5MHz	QPSK	133297	25RB#0	VN	NT	-3.33	-0.004893	±2.5	PASS
Band71	5MHz	QPSK	133297	25RB#0	VH	NT	1.53	0.002248	±2.5	PASS
Band71	5MHz	QPSK	133447	25RB#0	VL	NT	-1.49	-0.002142	±2.5	PASS
Band71	5MHz	QPSK	133447	25RB#0	VN	NT	1.67	0.002401	±2.5	PASS
Band71	5MHz	QPSK	133447	25RB#0	VH	NT	-3.55	-0.005104	±2.5	PASS
Band71	5MHz	16QAM	133147	25RB#0	VL	NT	-5.91	-0.008881	±2.5	PASS
Band71	5MHz	16QAM	133147	25RB#0	VN	NT	-3.26	-0.004899	±2.5	PASS
Band71	5MHz	16QAM	133147	25RB#0	VH	NT	-1.62	-0.002434	±2.5	PASS
Band71	5MHz	16QAM	133297	25RB#0	VL	NT	-6.57	-0.009655	±2.5	PASS
Band71	5MHz	16QAM	133297	25RB#0	VN	NT	-4.26	-0.006260	±2.5	PASS
Band71	5MHz	16QAM	133297	25RB#0	VH	NT	1.26	0.001852	±2.5	PASS
Band71	5MHz	16QAM	133447	25RB#0	VL	NT	-6.65	-0.009561	±2.5	PASS
Band71	5MHz	16QAM	133447	25RB#0	VN	NT	-3.99	-0.005737	±2.5	PASS
Band71	5MHz	16QAM	133447	25RB#0	VH	NT	-5.14	-0.007390	±2.5	PASS
Band71	10MHz	QPSK	133172	50RB#0	VL	NT	-2.88	-0.004311	±2.5	PASS
Band71	10MHz	QPSK	133172	50RB#0	VN	NT	-3.92	-0.005868	±2.5	PASS
Band71	10MHz	QPSK	133172	50RB#0	VH	NT	-5.09	-0.007620	±2.5	PASS
Band71	10MHz	QPSK	133297	50RB#0	VL	NT	-1.52	-0.002234	±2.5	PASS
Band71	10MHz	QPSK	133297	50RB#0	VN	NT	-5.49	-0.008068	±2.5	PASS
Band71	10MHz	QPSK	133297	50RB#0	VH	NT	-4.58	-0.006730	±2.5	PASS
Band71	10MHz	QPSK	133422	50RB#0	VL	NT	-2.15	-0.003102	±2.5	PASS

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

Band71	10MHz	QPSK	133422	50RB#0	VN	NT	3.16	0.004560	±2.5	PASS
Band71	10MHz	QPSK	133422	50RB#0	VH	NT	1.99	0.002872	±2.5	PASS
Band71	10MHz	16QAM	133172	50RB#0	VL	NT	-4.06	-0.006078	±2.5	PASS
Band71	10MHz	16QAM	133172	50RB#0	VN	NT	-6.97	-0.010434	±2.5	PASS
Band71	10MHz	16QAM	133172	50RB#0	VH	NT	-5.42	-0.008114	±2.5	PASS
Band71	10MHz	16QAM	133297	50RB#0	VL	NT	-4.42	-0.006495	±2.5	PASS
Band71	10MHz	16QAM	133297	50RB#0	VN	NT	-4.31	-0.006334	±2.5	PASS
Band71	10MHz	16QAM	133297	50RB#0	VH	NT	-5.38	-0.007906	±2.5	PASS
Band71	10MHz	16QAM	133422	50RB#0	VL	NT	-3.13	-0.004517	±2.5	PASS
Band71	10MHz	16QAM	133422	50RB#0	VN	NT	-3.91	-0.005642	±2.5	PASS
Band71	10MHz	16QAM	133422	50RB#0	VH	NT	-2.79	-0.004026	±2.5	PASS
Band71	15MHz	QPSK	133197	75RB#0	VL	NT	-6.11	-0.009113	±2.5	PASS
Band71	15MHz	QPSK	133197	75RB#0	VN	NT	-4.76	-0.007099	±2.5	PASS
Band71	15MHz	QPSK	133197	75RB#0	VH	NT	-6.19	-0.009232	±2.5	PASS
Band71	15MHz	QPSK	133297	75RB#0	VL	NT	-3.81	-0.005599	±2.5	PASS
Band71	15MHz	QPSK	133297	75RB#0	VN	NT	1.19	0.001749	±2.5	PASS
Band71	15MHz	QPSK	133297	75RB#0	VH	NT	-2.46	-0.003615	±2.5	PASS
Band71	15MHz	QPSK	133397	75RB#0	VL	NT	-5.55	-0.008038	±2.5	PASS
Band71	15MHz	QPSK	133397	75RB#0	VN	NT	-3.53	-0.005112	±2.5	PASS
Band71	15MHz	QPSK	133397	75RB#0	VH	NT	-3.02	-0.004374	±2.5	PASS
Band71	15MHz	16QAM	133197	75RB#0	VL	NT	-3.48	-0.005190	±2.5	PASS
Band71	15MHz	16QAM	133197	75RB#0	VN	NT	-4.13	-0.006160	±2.5	PASS
Band71	15MHz	16QAM	133197	75RB#0	VH	NT	-4.79	-0.007144	±2.5	PASS
Band71	15MHz	16QAM	133297	75RB#0	VL	NT	-1.19	-0.001749	±2.5	PASS
Band71	15MHz	16QAM	133297	75RB#0	VN	NT	1.73	0.002542	±2.5	PASS
Band71	15MHz	16QAM	133297	75RB#0	VH	NT	-4.61	-0.006774	±2.5	PASS
Band71	15MHz	16QAM	133397	75RB#0	VL	NT	-5.14	-0.007444	±2.5	PASS
Band71	15MHz	16QAM	133397	75RB#0	VN	NT	-1.56	-0.002259	±2.5	PASS
Band71	15MHz	16QAM	133397	75RB#0	VH	NT	-2.17	-0.003143	±2.5	PASS
Band71	20MHz	QPSK	133222	100RB#0	VL	NT	-4.23	-0.006285	±2.5	PASS
Band71	20MHz	QPSK	133222	100RB#0	VN	NT	-2.35	-0.003492	±2.5	PASS
Band71	20MHz	QPSK	133222	100RB#0	VH	NT	4.61	0.006850	±2.5	PASS
Band71	20MHz	QPSK	133322	100RB#0	VL	NT	2.73	0.003997	±2.5	PASS
Band71	20MHz	QPSK	133322	100RB#0	VN	NT	-3.12	-0.004568	±2.5	PASS
Band71	20MHz	QPSK	133322	100RB#0	VH	NT	3.86	0.005652	±2.5	PASS
Band71	20MHz	QPSK	133372	100RB#0	VL	NT	-5.05	-0.007340	±2.5	PASS
Band71	20MHz	QPSK	133372	100RB#0	VN	NT	4.43	0.006439	±2.5	PASS
Band71	20MHz	QPSK	133372	100RB#0	VH	NT	-3.15	-0.004578	±2.5	PASS
Band71	20MHz	16QAM	133222	100RB#0	VL	NT	-4.33	-0.006434	±2.5	PASS
Band71	20MHz	16QAM	133222	100RB#0	VN	NT	-4.78	-0.007103	±2.5	PASS
Band71	20MHz	16QAM	133222	100RB#0	VH	NT	-3.32	-0.004933	±2.5	PASS
Band71	20MHz	16QAM	133322	100RB#0	VL	NT	-4.42	-0.006471	±2.5	PASS
Band71	20MHz	16QAM	133322	100RB#0	VN	NT	3.49	0.005110	±2.5	PASS
Band71	20MHz	16QAM	133322	100RB#0	VH	NT	-3.10	-0.004539	±2.5	PASS
Band71	20MHz	16QAM	133372	100RB#0	VL	NT	-3.08	-0.004477	±2.5	PASS
Band71	20MHz	16QAM	133372	100RB#0	VN	NT	-4.69	-0.006817	±2.5	PASS
Band71	20MHz	16QAM	133372	100RB#0	VH	NT	-3.58	-0.005203	±2.5	PASS

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

Temperature										
Band	Bandwidth	Modulation	Channel	RB Configure	Voltage [Vdc]	Temperature (℃)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
Band2	1.4MHz	QPSK	18900	6RB#0	NV	-30	2.95	0.001569	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	-20	5.55	0.002952	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	-10	6.67	0.003548	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	0	5.46	0.002904	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	10	5.18	0.002755	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	20	8.47	0.004505	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	30	8.54	0.004543	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	40	4.09	0.002176	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	50	3.96	0.002106	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	-30	13.07	0.006952	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	-20	4.99	0.002654	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	-10	4.43	0.002356	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	0	3.91	0.002080	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	10	-2.55	-0.001356	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	20	5.18	0.002755	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	30	5.81	0.003090	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	40	5.41	0.002878	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	50	6.52	0.003468	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	-30	2.36	0.001255	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	-20	3.52	0.001872	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	-10	-7.68	-0.004085	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	0	-1.99	-0.001059	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	10	5.36	0.002851	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	20	5.25	0.002793	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	30	-3.16	-0.001681	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	40	4.26	0.002266	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	50	5.78	0.003074	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	-30	3.13	0.001665	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	-20	-6.02	-0.003202	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	-10	1.87	0.000995	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	0	-2.19	-0.001165	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	10	3.99	0.002122	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	20	4.43	0.002356	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	30	7.34	0.003904	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	40	5.46	0.002904	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	50	7.01	0.003729	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	-30	-4.94	-0.002628	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	-20	2.36	0.001255	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	-10	-3.46	-0.001840	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	0	1.93	0.001027	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	10	-4.66	-0.002479	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	20	6.95	0.003697	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	30	-6.34	-0.003372	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	40	-3.06	-0.001628	±2.5	PASS

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

Band2	15MHz	QPSK	18900	75RB#0	NV	50	7.54	0.004011	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	-30	4.16	0.002213	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	-20	-2.79	-0.001484	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	-10	5.98	0.003181	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	0	3.45	0.001835	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	10	2.93	0.001559	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	20	1.93	0.001027	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	30	6.44	0.003426	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	40	6.28	0.003340	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	50	4.81	0.002559	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	NV	-30	5.19	0.002996	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	NV	-20	4.61	0.002661	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	NV	-10	5.59	0.003227	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	NV	0	6.79	0.003919	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	NV	10	3.26	0.001882	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	NV	20	-2.83	-0.001633	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	NV	30	7.21	0.004162	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	NV	40	6.09	0.003515	±2.5	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	NV	50	-2.20	-0.001270	±2.5	PASS
Band4	3MHz	QPSK	20175	15RB#0	NV	-30	-4.86	-0.002805	±2.5	PASS
Band4	3MHz	QPSK	20175	15RB#0	NV	-20	1.40	0.000808	±2.5	PASS
Band4	3MHz	QPSK	20175	15RB#0	NV	-10	-3.76	-0.002170	±2.5	PASS
Band4	3MHz	QPSK	20175	15RB#0	NV	0	3.79	0.002188	±2.5	PASS
Band4	3MHz	QPSK	20175	15RB#0	NV	10	4.15	0.002395	±2.5	PASS
Band4	3MHz	QPSK	20175	15RB#0	NV	20	5.62	0.003244	±2.5	PASS
Band4	3MHz	QPSK	20175	15RB#0	NV	30	2.06	0.001189	±2.5	PASS
Band4	3MHz	QPSK	20175	15RB#0	NV	40	5.29	0.003053	±2.5	PASS
Band4	3MHz	QPSK	20175	15RB#0	NV	50	4.01	0.002315	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	NV	-30	3.52	0.002032	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	NV	-20	3.08	0.001778	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	NV	-10	3.05	0.001760	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	NV	0	-2.57	-0.001483	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	NV	10	3.96	0.002286	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	NV	20	6.59	0.003804	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	NV	30	2.99	0.001726	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	NV	40	2.65	0.001530	±2.5	PASS
Band4	5MHz	QPSK	20175	25RB#0	NV	50	7.98	0.004606	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	NV	-30	3.96	0.002286	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	NV	-20	3.30	0.001905	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	NV	-10	2.65	0.001530	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	NV	0	3.23	0.001864	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	NV	10	5.04	0.002909	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	NV	20	4.68	0.002701	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	NV	30	7.12	0.004110	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	NV	40	3.96	0.002286	±2.5	PASS
Band4	10MHz	QPSK	20175	50RB#0	NV	50	6.27	0.003619	±2.5	PASS
Band4	15MHz	QPSK	20175	75RB#0	NV	-30	4.36	0.002517	±2.5	PASS
Band4	15MHz	QPSK	20175	75RB#0	NV	-20	4.42	0.002551	±2.5	PASS

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

Band4	15MHz	QPSK	20175	75RB#0	NV	-10	5.25	0.003030	±2.5	PASS
Band4	15MHz	QPSK	20175	75RB#0	NV	0	5.16	0.002978	±2.5	PASS
Band4	15MHz	QPSK	20175	75RB#0	NV	10	6.75	0.003896	±2.5	PASS
Band4	15MHz	QPSK	20175	75RB#0	NV	20	4.84	0.002794	±2.5	PASS
Band4	15MHz	QPSK	20175	75RB#0	NV	30	4.09	0.002361	±2.5	PASS
Band4	15MHz	QPSK	20175	75RB#0	NV	40	2.92	0.001685	±2.5	PASS
Band4	15MHz	QPSK	20175	75RB#0	NV	50	9.00	0.005195	±2.5	PASS
Band4	20MHz	QPSK	20175	100RB#0	NV	-30	5.39	0.003111	±2.5	PASS
Band4	20MHz	QPSK	20175	100RB#0	NV	-20	4.61	0.002661	±2.5	PASS
Band4	20MHz	QPSK	20175	100RB#0	NV	-10	-2.49	-0.001437	±2.5	PASS
Band4	20MHz	QPSK	20175	100RB#0	NV	0	5.59	0.003227	±2.5	PASS
Band4	20MHz	QPSK	20175	100RB#0	NV	10	4.95	0.002857	±2.5	PASS
Band4	20MHz	QPSK	20175	100RB#0	NV	20	4.21	0.002430	±2.5	PASS
Band4	20MHz	QPSK	20175	100RB#0	NV	30	7.12	0.004110	±2.5	PASS
Band4	20MHz	QPSK	20175	100RB#0	NV	40	5.22	0.003013	±2.5	PASS
Band4	20MHz	QPSK	20175	100RB#0	NV	50	4.81	0.002776	±2.5	PASS
Band5	1.4MHz	QPSK	20525	6RB#0	NV	-30	-4.01	-0.004794	±2.5	PASS
Band5	1.4MHz	QPSK	20525	6RB#0	NV	-20	-3.42	-0.004088	±2.5	PASS
Band5	1.4MHz	QPSK	20525	6RB#0	NV	-10	-4.82	-0.005762	±2.5	PASS
Band5	1.4MHz	QPSK	20525	6RB#0	NV	0	-4.03	-0.004818	±2.5	PASS
Band5	1.4MHz	QPSK	20525	6RB#0	NV	10	-4.35	-0.005200	±2.5	PASS
Band5	1.4MHz	QPSK	20525	6RB#0	NV	20	-9.24	-0.011046	±2.5	PASS
Band5	1.4MHz	QPSK	20525	6RB#0	NV	30	-8.44	-0.010090	±2.5	PASS
Band5	1.4MHz	QPSK	20525	6RB#0	NV	40	-5.78	-0.006910	±2.5	PASS
Band5	1.4MHz	QPSK	20525	6RB#0	NV	50	-6.58	-0.007866	±2.5	PASS
Band5	3MHz	QPSK	20525	15RB#0	NV	-30	-6.68	-0.007986	±2.5	PASS
Band5	3MHz	QPSK	20525	15RB#0	NV	-20	-2.66	-0.003180	±2.5	PASS
Band5	3MHz	QPSK	20525	15RB#0	NV	-10	-6.81	-0.008141	±2.5	PASS
Band5	3MHz	QPSK	20525	15RB#0	NV	0	-1.54	-0.001841	±2.5	PASS
Band5	3MHz	QPSK	20525	15RB#0	NV	10	-1.75	-0.002092	±2.5	PASS
Band5	3MHz	QPSK	20525	15RB#0	NV	20	-1.10	-0.001315	±2.5	PASS
Band5	3MHz	QPSK	20525	15RB#0	NV	30	4.09	0.004889	±2.5	PASS
Band5	3MHz	QPSK	20525	15RB#0	NV	40	2.88	0.003443	±2.5	PASS
Band5	3MHz	QPSK	20525	15RB#0	NV	50	-1.54	-0.001841	±2.5	PASS
Band5	5MHz	QPSK	20525	25RB#0	NV	-30	-2.82	-0.003371	±2.5	PASS
Band5	5MHz	QPSK	20525	25RB#0	NV	-20	1.50	0.001793	±2.5	PASS
Band5	5MHz	QPSK	20525	25RB#0	NV	-10	-2.95	-0.003527	±2.5	PASS
Band5	5MHz	QPSK	20525	25RB#0	NV	0	-8.61	-0.010293	±2.5	PASS
Band5	5MHz	QPSK	20525	25RB#0	NV	10	-5.55	-0.006635	±2.5	PASS
Band5	5MHz	QPSK	20525	25RB#0	NV	20	1.43	0.001710	±2.5	PASS
Band5	5MHz	QPSK	20525	25RB#0	NV	30	-5.02	-0.006001	±2.5	PASS
Band5	5MHz	QPSK	20525	25RB#0	NV	40	-3.91	-0.004674	±2.5	PASS
Band5	5MHz	QPSK	20525	25RB#0	NV	50	-3.42	-0.004088	±2.5	PASS
Band5	10MHz	QPSK	20525	50RB#0	NV	-30	-3.79	-0.004531	±2.5	PASS
Band5	10MHz	QPSK	20525	50RB#0	NV	-20	-1.53	-0.001829	±2.5	PASS
Band5	10MHz	QPSK	20525	50RB#0	NV	-10	-5.06	-0.006049	±2.5	PASS
Band5	10MHz	QPSK	20525	50RB#0	NV	0	-2.85	-0.003407	±2.5	PASS
Band5	10MHz	QPSK	20525	50RB#0	NV	10	-3.06	-0.003658	±2.5	PASS

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

Band5	10MHz	QPSK	20525	50RB#0	NV	20	-6.19	-0.007400	±2.5	PASS
Band5	10MHz	QPSK	20525	50RB#0	NV	30	-2.27	-0.002714	±2.5	PASS
Band5	10MHz	QPSK	20525	50RB#0	NV	40	-4.88	-0.005834	±2.5	PASS
Band5	10MHz	QPSK	20525	50RB#0	NV	50	-4.81	-0.005750	±2.5	PASS
Band7	5MHz	QPSK	20775	25RB#0	NV	-30	-9.46	-0.003780	±2.5	PASS
Band7	5MHz	QPSK	20775	25RB#0	NV	-20	2.60	0.001039	±2.5	PASS
Band7	5MHz	QPSK	20775	25RB#0	NV	-10	8.91	0.003560	±2.5	PASS
Band7	5MHz	QPSK	20775	25RB#0	NV	0	-6.47	-0.002585	±2.5	PASS
Band7	5MHz	QPSK	20775	25RB#0	NV	10	7.14	0.002853	±2.5	PASS
Band7	5MHz	QPSK	20775	25RB#0	NV	20	6.21	0.002482	±2.5	PASS
Band7	5MHz	QPSK	20775	25RB#0	NV	30	-9.53	-0.003808	±2.5	PASS
Band7	5MHz	QPSK	20775	25RB#0	NV	40	5.65	0.002258	±2.5	PASS
Band7	5MHz	QPSK	20775	25RB#0	NV	50	9.00	0.003596	±2.5	PASS
Band7	5MHz	QPSK	21100	25RB#0	NV	-30	-6.07	-0.002394	±2.5	PASS
Band7	5MHz	QPSK	21100	25RB#0	NV	-20	8.71	0.003436	±2.5	PASS
Band7	5MHz	QPSK	21100	25RB#0	NV	-10	8.83	0.003483	±2.5	PASS
Band7	5MHz	QPSK	21100	25RB#0	NV	0	7.93	0.003128	±2.5	PASS
Band7	5MHz	QPSK	21100	25RB#0	NV	10	-5.24	-0.002067	±2.5	PASS
Band7	5MHz	QPSK	21100	25RB#0	NV	20	5.11	0.002016	±2.5	PASS
Band7	5MHz	QPSK	21100	25RB#0	NV	30	-5.87	-0.002316	±2.5	PASS
Band7	5MHz	QPSK	21100	25RB#0	NV	40	3.52	0.001389	±2.5	PASS
Band7	5MHz	QPSK	21100	25RB#0	NV	50	5.84	0.002304	±2.5	PASS
Band7	5MHz	QPSK	21425	25RB#0	NV	-30	2.32	0.000904	±2.5	PASS
Band7	5MHz	QPSK	21425	25RB#0	NV	-20	5.64	0.002197	±2.5	PASS
Band7	5MHz	QPSK	21425	25RB#0	NV	-10	4.12	0.001605	±2.5	PASS
Band7	5MHz	QPSK	21425	25RB#0	NV	0	-5.48	-0.002134	±2.5	PASS
Band7	5MHz	QPSK	21425	25RB#0	NV	10	7.20	0.002804	±2.5	PASS
Band7	5MHz	QPSK	21425	25RB#0	NV	20	-3.69	-0.001437	±2.5	PASS
Band7	5MHz	QPSK	21425	25RB#0	NV	30	7.18	0.002796	±2.5	PASS
Band7	5MHz	QPSK	21425	25RB#0	NV	40	5.74	0.002236	±2.5	PASS
Band7	5MHz	QPSK	21425	25RB#0	NV	50	2.73	0.001063	±2.5	PASS
Band7	10MHz	QPSK	20800	50RB#0	NV	-30	5.09	0.002032	±2.5	PASS
Band7	10MHz	QPSK	20800	50RB#0	NV	-20	7.42	0.002962	±2.5	PASS
Band7	10MHz	QPSK	20800	50RB#0	NV	-10	5.55	0.002216	±2.5	PASS
Band7	10MHz	QPSK	20800	50RB#0	NV	0	-4.78	-0.001908	±2.5	PASS
Band7	10MHz	QPSK	20800	50RB#0	NV	10	5.31	0.002120	±2.5	PASS
Band7	10MHz	QPSK	20800	50RB#0	NV	20	4.25	0.001697	±2.5	PASS
Band7	10MHz	QPSK	20800	50RB#0	NV	30	7.57	0.003022	±2.5	PASS
Band7	10MHz	QPSK	20800	50RB#0	NV	40	-6.77	-0.002703	±2.5	PASS
Band7	10MHz	QPSK	20800	50RB#0	NV	50	-4.01	-0.001601	±2.5	PASS
Band7	10MHz	QPSK	21100	50RB#0	NV	-30	4.19	0.001653	±2.5	PASS
Band7	10MHz	QPSK	21100	50RB#0	NV	-20	3.49	0.001377	±2.5	PASS
Band7	10MHz	QPSK	21100	50RB#0	NV	-10	-2.86	-0.001128	±2.5	PASS
Band7	10MHz	QPSK	21100	50RB#0	NV	0	-3.30	-0.001302	±2.5	PASS
Band7	10MHz	QPSK	21100	50RB#0	NV	10	-6.85	-0.002702	±2.5	PASS
Band7	10MHz	QPSK	21100	50RB#0	NV	20	-10.16	-0.004008	±2.5	PASS
Band7	10MHz	QPSK	21100	50RB#0	NV	30	-8.23	-0.003247	±2.5	PASS
Band7	10MHz	QPSK	21100	50RB#0	NV	40	-6.18	-0.002438	±2.5	PASS

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

Band7	10MHz	QPSK	21100	50RB#0	NV	50	5.44	0.002146	±2.5	PASS
Band7	10MHz	QPSK	21400	50RB#0	NV	-30	-6.02	-0.002347	±2.5	PASS
Band7	10MHz	QPSK	21400	50RB#0	NV	-20	-11.57	-0.004511	±2.5	PASS
Band7	10MHz	QPSK	21400	50RB#0	NV	-10	-8.28	-0.003228	±2.5	PASS
Band7	10MHz	QPSK	21400	50RB#0	NV	0	-9.27	-0.003614	±2.5	PASS
Band7	10MHz	QPSK	21400	50RB#0	NV	10	-2.12	-0.000827	±2.5	PASS
Band7	10MHz	QPSK	21400	50RB#0	NV	20	-5.55	-0.002164	±2.5	PASS
Band7	10MHz	QPSK	21400	50RB#0	NV	30	-7.40	-0.002885	±2.5	PASS
Band7	10MHz	QPSK	21400	50RB#0	NV	40	-8.87	-0.003458	±2.5	PASS
Band7	10MHz	QPSK	21400	50RB#0	NV	50	-6.44	-0.002511	±2.5	PASS
Band7	15MHz	QPSK	20825	75RB#0	NV	-30	8.34	0.003326	±2.5	PASS
Band7	15MHz	QPSK	20825	75RB#0	NV	-20	8.80	0.003509	±2.5	PASS
Band7	15MHz	QPSK	20825	75RB#0	NV	-10	8.44	0.003366	±2.5	PASS
Band7	15MHz	QPSK	20825	75RB#0	NV	0	13.95	0.005563	±2.5	PASS
Band7	15MHz	QPSK	20825	75RB#0	NV	10	4.45	0.001775	±2.5	PASS
Band7	15MHz	QPSK	20825	75RB#0	NV	20	8.90	0.003549	±2.5	PASS
Band7	15MHz	QPSK	20825	75RB#0	NV	30	9.81	0.003912	±2.5	PASS
Band7	15MHz	QPSK	20825	75RB#0	NV	40	-5.82	-0.002321	±2.5	PASS
Band7	15MHz	QPSK	20825	75RB#0	NV	50	8.68	0.003462	±2.5	PASS
Band7	15MHz	QPSK	21100	75RB#0	NV	-30	3.89	0.001535	±2.5	PASS
Band7	15MHz	QPSK	21100	75RB#0	NV	-20	-3.85	-0.001519	±2.5	PASS
Band7	15MHz	QPSK	21100	75RB#0	NV	-10	5.21	0.002055	±2.5	PASS
Band7	15MHz	QPSK	21100	75RB#0	NV	0	5.74	0.002264	±2.5	PASS
Band7	15MHz	QPSK	21100	75RB#0	NV	10	6.27	0.002473	±2.5	PASS
Band7	15MHz	QPSK	21100	75RB#0	NV	20	9.70	0.003826	±2.5	PASS
Band7	15MHz	QPSK	21100	75RB#0	NV	30	2.93	0.001156	±2.5	PASS
Band7	15MHz	QPSK	21100	75RB#0	NV	40	3.99	0.001574	±2.5	PASS
Band7	15MHz	QPSK	21100	75RB#0	NV	50	-5.71	-0.002252	±2.5	PASS
Band7	15MHz	QPSK	21375	75RB#0	NV	-30	-5.82	-0.002271	±2.5	PASS
Band7	15MHz	QPSK	21375	75RB#0	NV	-20	-5.25	-0.002049	±2.5	PASS
Band7	15MHz	QPSK	21375	75RB#0	NV	-10	3.79	0.001479	±2.5	PASS
Band7	15MHz	QPSK	21375	75RB#0	NV	0	-5.46	-0.002131	±2.5	PASS
Band7	15MHz	QPSK	21375	75RB#0	NV	10	5.76	0.002248	±2.5	PASS
Band7	15MHz	QPSK	21375	75RB#0	NV	20	-5.42	-0.002115	±2.5	PASS
Band7	15MHz	QPSK	21375	75RB#0	NV	30	-4.45	-0.001737	±2.5	PASS
Band7	15MHz	QPSK	21375	75RB#0	NV	40	3.60	0.001405	±2.5	PASS
Band7	15MHz	QPSK	21375	75RB#0	NV	50	-5.41	-0.002111	±2.5	PASS
Band7	20MHz	QPSK	20850	100RB#0	NV	-30	-7.00	-0.002789	±2.5	PASS
Band7	20MHz	QPSK	20850	100RB#0	NV	-20	-9.23	-0.003677	±2.5	PASS
Band7	20MHz	QPSK	20850	100RB#0	NV	-10	5.29	0.002108	±2.5	PASS
Band7	20MHz	QPSK	20850	100RB#0	NV	0	-6.22	-0.002478	±2.5	PASS
Band7	20MHz	QPSK	20850	100RB#0	NV	10	3.39	0.001351	±2.5	PASS
Band7	20MHz	QPSK	20850	100RB#0	NV	20	-1.56	-0.000622	±2.5	PASS
Band7	20MHz	QPSK	20850	100RB#0	NV	30	-2.15	-0.000857	±2.5	PASS
Band7	20MHz	QPSK	20850	100RB#0	NV	40	-4.69	-0.001869	±2.5	PASS
Band7	20MHz	QPSK	20850	100RB#0	NV	50	4.29	0.001709	±2.5	PASS
Band7	20MHz	QPSK	21100	100RB#0	NV	-30	-4.13	-0.001629	±2.5	PASS
Band7	20MHz	QPSK	21100	100RB#0	NV	-20	-2.65	-0.001045	±2.5	PASS

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

Band7	20MHz	QPSK	21100	100RB#0	NV	-10	-5.22	-0.002059	±2.5	PASS
Band7	20MHz	QPSK	21100	100RB#0	NV	0	5.24	0.002067	±2.5	PASS
Band7	20MHz	QPSK	21100	100RB#0	NV	10	-7.51	-0.002963	±2.5	PASS
Band7	20MHz	QPSK	21100	100RB#0	NV	20	4.91	0.001937	±2.5	PASS
Band7	20MHz	QPSK	21100	100RB#0	NV	30	-4.35	-0.001716	±2.5	PASS
Band7	20MHz	QPSK	21100	100RB#0	NV	40	-6.28	-0.002477	±2.5	PASS
Band7	20MHz	QPSK	21100	100RB#0	NV	50	-7.91	-0.003120	±2.5	PASS
Band7	20MHz	QPSK	21350	100RB#0	NV	-30	6.31	0.002465	±2.5	PASS
Band7	20MHz	QPSK	21350	100RB#0	NV	-20	6.08	0.002375	±2.5	PASS
Band7	20MHz	QPSK	21350	100RB#0	NV	-10	8.58	0.003352	±2.5	PASS
Band7	20MHz	QPSK	21350	100RB#0	NV	0	-7.42	-0.002898	±2.5	PASS
Band7	20MHz	QPSK	21350	100RB#0	NV	10	8.13	0.003176	±2.5	PASS
Band7	20MHz	QPSK	21350	100RB#0	NV	20	5.88	0.002297	±2.5	PASS
Band7	20MHz	QPSK	21350	100RB#0	NV	30	10.49	0.004098	±2.5	PASS
Band7	20MHz	QPSK	21350	100RB#0	NV	40	6.52	0.002547	±2.5	PASS
Band7	20MHz	QPSK	21350	100RB#0	NV	50	6.47	0.002527	±2.5	PASS
Band12	1.4MHz	QPSK	23095	6RB#0	NV	-30	2.73	0.003859	±2.5	PASS
Band12	1.4MHz	QPSK	23095	6RB#0	NV	-20	1.96	0.002770	±2.5	PASS
Band12	1.4MHz	QPSK	23095	6RB#0	NV	-10	2.53	0.003576	±2.5	PASS
Band12	1.4MHz	QPSK	23095	6RB#0	NV	0	-2.09	-0.002954	±2.5	PASS
Band12	1.4MHz	QPSK	23095	6RB#0	NV	10	2.35	0.003322	±2.5	PASS
Band12	1.4MHz	QPSK	23095	6RB#0	NV	20	-1.79	-0.002530	±2.5	PASS
Band12	1.4MHz	QPSK	23095	6RB#0	NV	30	-2.12	-0.002996	±2.5	PASS
Band12	1.4MHz	QPSK	23095	6RB#0	NV	40	-3.26	-0.004608	±2.5	PASS
Band12	1.4MHz	QPSK	23095	6RB#0	NV	50	-1.60	-0.002261	±2.5	PASS
Band12	3MHz	QPSK	23095	15RB#0	NV	-30	-4.58	-0.006473	±2.5	PASS
Band12	3MHz	QPSK	23095	15RB#0	NV	-20	2.50	0.003534	±2.5	PASS
Band12	3MHz	QPSK	23095	15RB#0	NV	-10	-1.26	-0.001781	±2.5	PASS
Band12	3MHz	QPSK	23095	15RB#0	NV	0	-3.49	-0.004933	±2.5	PASS
Band12	3MHz	QPSK	23095	15RB#0	NV	10	-1.26	-0.001781	±2.5	PASS
Band12	3MHz	QPSK	23095	15RB#0	NV	20	1.93	0.002728	±2.5	PASS
Band12	3MHz	QPSK	23095	15RB#0	NV	30	-3.26	-0.004608	±2.5	PASS
Band12	3MHz	QPSK	23095	15RB#0	NV	40	-2.17	-0.003067	±2.5	PASS
Band12	3MHz	QPSK	23095	15RB#0	NV	50	-6.07	-0.008580	±2.5	PASS
Band12	5MHz	QPSK	23095	25RB#0	NV	-30	1.39	0.001965	±2.5	PASS
Band12	5MHz	QPSK	23095	25RB#0	NV	-20	2.82	0.003986	±2.5	PASS
Band12	5MHz	QPSK	23095	25RB#0	NV	-10	2.40	0.003392	±2.5	PASS
Band12	5MHz	QPSK	23095	25RB#0	NV	0	4.28	0.006049	±2.5	PASS
Band12	5MHz	QPSK	23095	25RB#0	NV	10	0.89	0.001258	±2.5	PASS
Band12	5MHz	QPSK	23095	25RB#0	NV	20	-4.51	-0.006375	±2.5	PASS
Band12	5MHz	QPSK	23095	25RB#0	NV	30	-1.39	-0.001965	±2.5	PASS
Band12	5MHz	QPSK	23095	25RB#0	NV	40	-1.47	-0.002078	±2.5	PASS
Band12	5MHz	QPSK	23095	25RB#0	NV	50	-3.42	-0.004834	±2.5	PASS
Band12	10MHz	QPSK	23095	50RB#0	NV	-30	-1.26	-0.001781	±2.5	PASS
Band12	10MHz	QPSK	23095	50RB#0	NV	-20	5.32	0.007519	±2.5	PASS
Band12	10MHz	QPSK	23095	50RB#0	NV	-10	-2.17	-0.003067	±2.5	PASS
Band12	10MHz	QPSK	23095	50RB#0	NV	0	-4.62	-0.006530	±2.5	PASS
Band12	10MHz	QPSK	23095	50RB#0	NV	10	0.67	0.000947	±2.5	PASS

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

Band12	10MHz	QPSK	23095	50RB#0	NV	20	2.17	0.003067	±2.5	PASS
Band12	10MHz	QPSK	23095	50RB#0	NV	30	4.45	0.006290	±2.5	PASS
Band12	10MHz	QPSK	23095	50RB#0	NV	40	1.49	0.002106	±2.5	PASS
Band12	10MHz	QPSK	23095	50RB#0	NV	50	-1.20	-0.001696	±2.5	PASS
Band13	5MHz	QPSK	23230	25RB#0	NV	-30	5.34	0.006829	±2.5	PASS
Band13	5MHz	QPSK	23230	25RB#0	NV	-20	3.93	0.005026	±2.5	PASS
Band13	5MHz	QPSK	23230	25RB#0	NV	-10	-3.92	-0.005013	±2.5	PASS
Band13	5MHz	QPSK	23230	25RB#0	NV	0	-2.92	-0.003734	±2.5	PASS
Band13	5MHz	QPSK	23230	25RB#0	NV	10	-2.93	-0.003747	±2.5	PASS
Band13	5MHz	QPSK	23230	25RB#0	NV	20	-1.93	-0.002468	±2.5	PASS
Band13	5MHz	QPSK	23230	25RB#0	NV	30	3.88	0.004962	±2.5	PASS
Band13	5MHz	QPSK	23230	25RB#0	NV	40	-1.77	-0.002263	±2.5	PASS
Band13	5MHz	QPSK	23230	25RB#0	NV	50	1.09	0.001394	±2.5	PASS
Band13	10MHz	QPSK	23230	50RB#0	NV	-30	0.00	0.000000	±2.5	PASS
Band13	10MHz	QPSK	23230	50RB#0	NV	-20	0.00	0.000000	±2.5	PASS
Band13	10MHz	QPSK	23230	50RB#0	NV	-10	0.00	0.000000	±2.5	PASS
Band13	10MHz	QPSK	23230	50RB#0	NV	0	0.00	0.000000	±2.5	PASS
Band13	10MHz	QPSK	23230	50RB#0	NV	10	0.00	0.000000	±2.5	PASS
Band13	10MHz	QPSK	23230	50RB#0	NV	20	0.00	0.000000	±2.5	PASS
Band13	10MHz	QPSK	23230	50RB#0	NV	30	0.00	0.000000	±2.5	PASS
Band13	10MHz	QPSK	23230	50RB#0	NV	40	0.00	0.000000	±2.5	PASS
Band13	10MHz	QPSK	23230	50RB#0	NV	50	0.00	0.000000	±2.5	PASS
Band25	1.4MHz	QPSK	26365	6RB#0	NV	-30	-6.25	-0.003320	±2.5	PASS
Band25	1.4MHz	QPSK	26365	6RB#0	NV	-20	-8.18	-0.004345	±2.5	PASS
Band25	1.4MHz	QPSK	26365	6RB#0	NV	-10	-6.88	-0.003655	±2.5	PASS
Band25	1.4MHz	QPSK	26365	6RB#0	NV	0	5.39	0.002863	±2.5	PASS
Band25	1.4MHz	QPSK	26365	6RB#0	NV	10	8.94	0.004749	±2.5	PASS
Band25	1.4MHz	QPSK	26365	6RB#0	NV	20	9.18	0.004876	±2.5	PASS
Band25	1.4MHz	QPSK	26365	6RB#0	NV	30	3.81	0.002024	±2.5	PASS
Band25	1.4MHz	QPSK	26365	6RB#0	NV	40	5.74	0.003049	±2.5	PASS
Band25	1.4MHz	QPSK	26365	6RB#0	NV	50	4.22	0.002242	±2.5	PASS
Band25	3MHz	QPSK	26365	15RB#0	NV	-30	4.46	0.002369	±2.5	PASS
Band25	3MHz	QPSK	26365	15RB#0	NV	-20	3.99	0.002120	±2.5	PASS
Band25	3MHz	QPSK	26365	15RB#0	NV	-10	4.09	0.002173	±2.5	PASS
Band25	3MHz	QPSK	26365	15RB#0	NV	0	8.88	0.004717	±2.5	PASS
Band25	3MHz	QPSK	26365	15RB#0	NV	10	-6.15	-0.003267	±2.5	PASS
Band25	3MHz	QPSK	26365	15RB#0	NV	20	-4.49	-0.002385	±2.5	PASS
Band25	3MHz	QPSK	26365	15RB#0	NV	30	-4.08	-0.002167	±2.5	PASS
Band25	3MHz	QPSK	26365	15RB#0	NV	40	5.35	0.002842	±2.5	PASS
Band25	3MHz	QPSK	26365	15RB#0	NV	50	3.29	0.001748	±2.5	PASS
Band25	5MHz	QPSK	26365	25RB#0	NV	-30	1.87	0.000993	±2.5	PASS
Band25	5MHz	QPSK	26365	25RB#0	NV	-20	6.21	0.003299	±2.5	PASS
Band25	5MHz	QPSK	26365	25RB#0	NV	-10	4.26	0.002263	±2.5	PASS
Band25	5MHz	QPSK	26365	25RB#0	NV	0	6.08	0.003230	±2.5	PASS
Band25	5MHz	QPSK	26365	25RB#0	NV	10	3.62	0.001923	±2.5	PASS
Band25	5MHz	QPSK	26365	25RB#0	NV	20	2.50	0.001328	±2.5	PASS
Band25	5MHz	QPSK	26365	25RB#0	NV	30	-2.22	-0.001179	±2.5	PASS
Band25	5MHz	QPSK	26365	25RB#0	NV	40	4.62	0.002454	±2.5	PASS

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

Band25	5MHz	QPSK	26365	25RB#0	NV	50	5.65	0.003001	±2.5	PASS
Band25	10MHz	QPSK	26365	50RB#0	NV	-30	-3.83	-0.002035	±2.5	PASS
Band25	10MHz	QPSK	26365	50RB#0	NV	-20	-3.25	-0.001726	±2.5	PASS
Band25	10MHz	QPSK	26365	50RB#0	NV	-10	-4.11	-0.002183	±2.5	PASS
Band25	10MHz	QPSK	26365	50RB#0	NV	0	3.13	0.001663	±2.5	PASS
Band25	10MHz	QPSK	26365	50RB#0	NV	10	-6.04	-0.003208	±2.5	PASS
Band25	10MHz	QPSK	26365	50RB#0	NV	20	-12.29	-0.006529	±2.5	PASS
Band25	10MHz	QPSK	26365	50RB#0	NV	30	-7.72	-0.004101	±2.5	PASS
Band25	10MHz	QPSK	26365	50RB#0	NV	40	-7.78	-0.004133	±2.5	PASS
Band25	10MHz	QPSK	26365	50RB#0	NV	50	-4.28	-0.002274	±2.5	PASS
Band25	15MHz	QPSK	26365	75RB#0	NV	-30	5.76	0.003060	±2.5	PASS
Band25	15MHz	QPSK	26365	75RB#0	NV	-20	5.84	0.003102	±2.5	PASS
Band25	15MHz	QPSK	26365	75RB#0	NV	-10	6.57	0.003490	±2.5	PASS
Band25	15MHz	QPSK	26365	75RB#0	NV	0	7.64	0.004058	±2.5	PASS
Band25	15MHz	QPSK	26365	75RB#0	NV	10	8.67	0.004606	±2.5	PASS
Band25	15MHz	QPSK	26365	75RB#0	NV	20	4.81	0.002555	±2.5	PASS
Band25	15MHz	QPSK	26365	75RB#0	NV	30	3.43	0.001822	±2.5	PASS
Band25	15MHz	QPSK	26365	75RB#0	NV	40	8.61	0.004574	±2.5	PASS
Band25	15MHz	QPSK	26365	75RB#0	NV	50	5.52	0.002932	±2.5	PASS
Band25	20MHz	QPSK	26365	100RB#0	NV	-30	4.69	0.002491	±2.5	PASS
Band25	20MHz	QPSK	26365	100RB#0	NV	-20	2.69	0.001429	±2.5	PASS
Band25	20MHz	QPSK	26365	100RB#0	NV	-10	6.94	0.003687	±2.5	PASS
Band25	20MHz	QPSK	26365	100RB#0	NV	0	-5.39	-0.002863	±2.5	PASS
Band25	20MHz	QPSK	26365	100RB#0	NV	10	2.56	0.001360	±2.5	PASS
Band25	20MHz	QPSK	26365	100RB#0	NV	20	-9.67	-0.005137	±2.5	PASS
Band25	20MHz	QPSK	26365	100RB#0	NV	30	2.19	0.001163	±2.5	PASS
Band25	20MHz	QPSK	26365	100RB#0	NV	40	5.25	0.002789	±2.5	PASS
Band25	20MHz	QPSK	26365	100RB#0	NV	50	3.53	0.001875	±2.5	PASS
Band26(814-824)	1.4MHz	QPSK	26740	6RB#0	NV	-30	2.70	0.003297	±2.5	PASS
Band26(814-824)	1.4MHz	QPSK	26740	6RB#0	NV	-20	-1.32	-0.001612	±2.5	PASS
Band26(814-824)	1.4MHz	QPSK	26740	6RB#0	NV	-10	-2.02	-0.002466	±2.5	PASS
Band26(814-824)	1.4MHz	QPSK	26740	6RB#0	NV	0	-3.50	-0.004274	±2.5	PASS
Band26(814-824)	1.4MHz	QPSK	26740	6RB#0	NV	10	-5.69	-0.006947	±2.5	PASS
Band26(814-824)	1.4MHz	QPSK	26740	6RB#0	NV	20	-3.95	-0.004823	±2.5	PASS
Band26(814-824)	1.4MHz	QPSK	26740	6RB#0	NV	30	-4.55	-0.005556	±2.5	PASS
Band26(814-824)	1.4MHz	QPSK	26740	6RB#0	NV	40	1.04	0.001270	±2.5	PASS
Band26(814-824)	1.4MHz	QPSK	26740	6RB#0	NV	50	-3.23	-0.003944	±2.5	PASS
Band26(814-824)	3MHz	QPSK	26740	15RB#0	NV	-30	3.26	0.003980	±2.5	PASS
Band26(814-824)	3MHz	QPSK	26740	15RB#0	NV	-20	-3.66	-0.004469	±2.5	PASS
Band26(814-824)	3MHz	QPSK	26740	15RB#0	NV	-10	-3.15	-0.003846	±2.5	PASS
Band26(814-824)	3MHz	QPSK	26740	15RB#0	NV	0	2.57	0.003138	±2.5	PASS

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

Band26(814-824)	3MHz	QPSK	26740	15RB#0	NV	10	-3.82	-0.004664	±2.5	PASS
Band26(814-824)	3MHz	QPSK	26740	15RB#0	NV	20	-3.12	-0.003810	±2.5	PASS
Band26(814-824)	3MHz	QPSK	26740	15RB#0	NV	30	-3.73	-0.004554	±2.5	PASS
Band26(814-824)	3MHz	QPSK	26740	15RB#0	NV	40	-4.56	-0.005568	±2.5	PASS
Band26(814-824)	3MHz	QPSK	26740	15RB#0	NV	50	-5.82	-0.007106	±2.5	PASS
Band26(814-824)	5MHz	QPSK	26740	25RB#0	NV	-30	3.39	0.004139	±2.5	PASS
Band26(814-824)	5MHz	QPSK	26740	25RB#0	NV	-20	-1.73	-0.002112	±2.5	PASS
Band26(814-824)	5MHz	QPSK	26740	25RB#0	NV	-10	2.00	0.002442	±2.5	PASS
Band26(814-824)	5MHz	QPSK	26740	25RB#0	NV	0	-4.94	-0.006032	±2.5	PASS
Band26(814-824)	5MHz	QPSK	26740	25RB#0	NV	10	-5.22	-0.006374	±2.5	PASS
Band26(814-824)	5MHz	QPSK	26740	25RB#0	NV	20	7.25	0.008852	±2.5	PASS
Band26(814-824)	5MHz	QPSK	26740	25RB#0	NV	30	6.67	0.008144	±2.5	PASS
Band26(814-824)	5MHz	QPSK	26740	25RB#0	NV	40	-4.29	-0.005238	±2.5	PASS
Band26(814-824)	5MHz	QPSK	26740	25RB#0	NV	50	3.59	0.004383	±2.5	PASS
Band26(814-824)	10MHz	QPSK	26740	50RB#0	NV	-30	0.00	0.000000	±2.5	PASS
Band26(814-824)	10MHz	QPSK	26740	50RB#0	NV	-20	0.00	0.000000	±2.5	PASS
Band26(814-824)	10MHz	QPSK	26740	50RB#0	NV	-10	0.00	0.000000	±2.5	PASS
Band26(814-824)	10MHz	QPSK	26740	50RB#0	NV	0	0.00	0.000000	±2.5	PASS
Band26(814-824)	10MHz	QPSK	26740	50RB#0	NV	10	0.00	0.000000	±2.5	PASS
Band26(814-824)	10MHz	QPSK	26740	50RB#0	NV	20	0.00	0.000000	±2.5	PASS
Band26(814-824)	10MHz	QPSK	26740	50RB#0	NV	30	0.00	0.000000	±2.5	PASS
Band26(814-824)	10MHz	QPSK	26740	50RB#0	NV	40	0.00	0.000000	±2.5	PASS
Band26(814-824)	10MHz	QPSK	26740	50RB#0	NV	50	0.00	0.000000	±2.5	PASS
Band26(824-849)	1.4MHz	QPSK	26915	6RB#0	NV	-30	-1.54	-0.001841	±2.5	PASS
Band26(824-849)	1.4MHz	QPSK	26915	6RB#0	NV	-20	-2.30	-0.002750	±2.5	PASS
Band26(824-849)	1.4MHz	QPSK	26915	6RB#0	NV	-10	5.98	0.007149	±2.5	PASS
Band26(824-849)	1.4MHz	QPSK	26915	6RB#0	NV	0	-1.36	-0.001626	±2.5	PASS
Band26(824-849)	1.4MHz	QPSK	26915	6RB#0	NV	10	4.79	0.005726	±2.5	PASS
Band26(824-849)	1.4MHz	QPSK	26915	6RB#0	NV	20	-6.15	-0.007352	±2.5	PASS
Band26(824-849)	1.4MHz	QPSK	26915	6RB#0	NV	30	-3.33	-0.003981	±2.5	PASS
Band26(824-849)	1.4MHz	QPSK	26915	6RB#0	NV	40	-3.20	-0.003825	±2.5	PASS
Band26(824-849)	1.4MHz	QPSK	26915	6RB#0	NV	50	3.48	0.004160	±2.5	PASS
Band26(824-849)	3MHz	QPSK	26915	15RB#0	NV	-30	-5.52	-0.006599	±2.5	PASS

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

Band26(824-849)	3MHz	QPSK	26915	15RB#0	NV	-20	-1.13	-0.001351	±2.5	PASS
Band26(824-849)	3MHz	QPSK	26915	15RB#0	NV	-10	-1.72	-0.002056	±2.5	PASS
Band26(824-849)	3MHz	QPSK	26915	15RB#0	NV	0	1.49	0.001781	±2.5	PASS
Band26(824-849)	3MHz	QPSK	26915	15RB#0	NV	10	-4.63	-0.005535	±2.5	PASS
Band26(824-849)	3MHz	QPSK	26915	15RB#0	NV	20	-4.33	-0.005176	±2.5	PASS
Band26(824-849)	3MHz	QPSK	26915	15RB#0	NV	30	-4.15	-0.004961	±2.5	PASS
Band26(824-849)	3MHz	QPSK	26915	15RB#0	NV	40	-3.49	-0.004172	±2.5	PASS
Band26(824-849)	3MHz	QPSK	26915	15RB#0	NV	50	3.83	0.004579	±2.5	PASS
Band26(824-849)	5MHz	QPSK	26915	25RB#0	NV	-30	-4.72	-0.005643	±2.5	PASS
Band26(824-849)	5MHz	QPSK	26915	25RB#0	NV	-20	-1.39	-0.001662	±2.5	PASS
Band26(824-849)	5MHz	QPSK	26915	25RB#0	NV	-10	-8.37	-0.010006	±2.5	PASS
Band26(824-849)	5MHz	QPSK	26915	25RB#0	NV	0	-6.25	-0.007472	±2.5	PASS
Band26(824-849)	5MHz	QPSK	26915	25RB#0	NV	10	-8.37	-0.010006	±2.5	PASS
Band26(824-849)	5MHz	QPSK	26915	25RB#0	NV	20	-0.86	-0.001028	±2.5	PASS
Band26(824-849)	5MHz	QPSK	26915	25RB#0	NV	30	-5.72	-0.006838	±2.5	PASS
Band26(824-849)	5MHz	QPSK	26915	25RB#0	NV	40	-1.42	-0.001698	±2.5	PASS
Band26(824-849)	5MHz	QPSK	26915	25RB#0	NV	50	4.98	0.005953	±2.5	PASS
Band26(824-849)	10MHz	QPSK	26915	50RB#0	NV	-30	-3.42	-0.004088	±2.5	PASS
Band26(824-849)	10MHz	QPSK	26915	50RB#0	NV	-20	-5.82	-0.006958	±2.5	PASS
Band26(824-849)	10MHz	QPSK	26915	50RB#0	NV	-10	-2.88	-0.003443	±2.5	PASS
Band26(824-849)	10MHz	QPSK	26915	50RB#0	NV	0	-6.59	-0.007878	±2.5	PASS
Band26(824-849)	10MHz	QPSK	26915	50RB#0	NV	10	-6.05	-0.007233	±2.5	PASS
Band26(824-849)	10MHz	QPSK	26915	50RB#0	NV	20	-6.15	-0.007352	±2.5	PASS
Band26(824-849)	10MHz	QPSK	26915	50RB#0	NV	30	-6.29	-0.007519	±2.5	PASS
Band26(824-849)	10MHz	QPSK	26915	50RB#0	NV	40	-5.21	-0.006228	±2.5	PASS
Band26(824-849)	10MHz	QPSK	26915	50RB#0	NV	50	-3.62	-0.004328	±2.5	PASS
Band26(824-849)	15MHz	QPSK	26915	75RB#0	NV	-30	4.38	0.005236	±2.5	PASS
Band26(824-849)	15MHz	QPSK	26915	75RB#0	NV	-20	-5.76	-0.006886	±2.5	PASS
Band26(824-849)	15MHz	QPSK	26915	75RB#0	NV	-10	-1.52	-0.001817	±2.5	PASS
Band26(824-849)	15MHz	QPSK	26915	75RB#0	NV	0	-4.78	-0.005714	±2.5	PASS
Band26(824-849)	15MHz	QPSK	26915	75RB#0	NV	10	-10.26	-0.012265	±2.5	PASS
Band26(824-849)	15MHz	QPSK	26915	75RB#0	NV	20	-5.41	-0.006467	±2.5	PASS
Band26(824-849)	15MHz	QPSK	26915	75RB#0	NV	30	3.38	0.004041	±2.5	PASS

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

Band26(824-849)	15MHz	QPSK	26915	75RB#0	NV	40	-4.66	-0.005571	±2.5	PASS
Band26(824-849)	15MHz	QPSK	26915	75RB#0	NV	50	-8.55	-0.010221	±2.5	PASS
Band41	5MHz	QPSK	40620	25RB#0	NV	-30	-37.25	-0.014366	±2.5	PASS
Band41	5MHz	QPSK	40620	25RB#0	NV	-20	-33.27	-0.012831	±2.5	PASS
Band41	5MHz	QPSK	40620	25RB#0	NV	-10	-33.16	-0.012788	±2.5	PASS
Band41	5MHz	QPSK	40620	25RB#0	NV	0	-34.06	-0.013135	±2.5	PASS
Band41	5MHz	QPSK	40620	25RB#0	NV	10	-33.46	-0.012904	±2.5	PASS
Band41	5MHz	QPSK	40620	25RB#0	NV	20	-42.03	-0.016209	±2.5	PASS
Band41	5MHz	QPSK	40620	25RB#0	NV	30	-37.57	-0.014489	±2.5	PASS
Band41	5MHz	QPSK	40620	25RB#0	NV	40	-42.36	-0.016336	±2.5	PASS
Band41	5MHz	QPSK	40620	25RB#0	NV	50	-41.38	-0.015958	±2.5	PASS
Band41	10MHz	QPSK	40620	50RB#0	NV	-30	-4.99	-0.001924	±2.5	PASS
Band41	10MHz	QPSK	40620	50RB#0	NV	-20	-3.35	-0.001292	±2.5	PASS
Band41	10MHz	QPSK	40620	50RB#0	NV	-10	-6.65	-0.002565	±2.5	PASS
Band41	10MHz	QPSK	40620	50RB#0	NV	0	-7.94	-0.003062	±2.5	PASS
Band41	10MHz	QPSK	40620	50RB#0	NV	10	-3.63	-0.001400	±2.5	PASS
Band41	10MHz	QPSK	40620	50RB#0	NV	20	4.18	0.001612	±2.5	PASS
Band41	10MHz	QPSK	40620	50RB#0	NV	30	-4.76	-0.001836	±2.5	PASS
Band41	10MHz	QPSK	40620	50RB#0	NV	40	-7.02	-0.002707	±2.5	PASS
Band41	10MHz	QPSK	40620	50RB#0	NV	50	-3.95	-0.001523	±2.5	PASS
Band41	15MHz	QPSK	40620	75RB#0	NV	-30	5.31	0.002048	±2.5	PASS
Band41	15MHz	QPSK	40620	75RB#0	NV	-20	3.95	0.001523	±2.5	PASS
Band41	15MHz	QPSK	40620	75RB#0	NV	-10	-5.88	-0.002268	±2.5	PASS
Band41	15MHz	QPSK	40620	75RB#0	NV	0	-9.43	-0.003637	±2.5	PASS
Band41	15MHz	QPSK	40620	75RB#0	NV	10	-4.72	-0.001820	±2.5	PASS
Band41	15MHz	QPSK	40620	75RB#0	NV	20	-5.66	-0.002183	±2.5	PASS
Band41	15MHz	QPSK	40620	75RB#0	NV	30	-4.28	-0.001651	±2.5	PASS
Band41	15MHz	QPSK	40620	75RB#0	NV	40	2.99	0.001153	±2.5	PASS
Band41	15MHz	QPSK	40620	75RB#0	NV	50	-7.71	-0.002973	±2.5	PASS
Band41	20MHz	QPSK	40620	100RB#0	NV	-30	-6.12	-0.002360	±2.5	PASS
Band41	20MHz	QPSK	40620	100RB#0	NV	-20	-4.18	-0.001612	±2.5	PASS
Band41	20MHz	QPSK	40620	100RB#0	NV	-10	-4.68	-0.001805	±2.5	PASS
Band41	20MHz	QPSK	40620	100RB#0	NV	0	-2.56	-0.000987	±2.5	PASS
Band41	20MHz	QPSK	40620	100RB#0	NV	10	-10.23	-0.003945	±2.5	PASS
Band41	20MHz	QPSK	40620	100RB#0	NV	20	-6.64	-0.002561	±2.5	PASS
Band41	20MHz	QPSK	40620	100RB#0	NV	30	-3.83	-0.001477	±2.5	PASS
Band41	20MHz	QPSK	40620	100RB#0	NV	40	-4.22	-0.001627	±2.5	PASS
Band41	20MHz	QPSK	40620	100RB#0	NV	50	-4.26	-0.001643	±2.5	PASS
Band66	1.4MHz	QPSK	132322	6RB#0	NV	-30	13.53	0.007754	±2.5	PASS
Band66	1.4MHz	QPSK	132322	6RB#0	NV	-20	13.59	0.007788	±2.5	PASS
Band66	1.4MHz	QPSK	132322	6RB#0	NV	-10	5.24	0.003003	±2.5	PASS
Band66	1.4MHz	QPSK	132322	6RB#0	NV	0	11.07	0.006344	±2.5	PASS
Band66	1.4MHz	QPSK	132322	6RB#0	NV	10	10.67	0.006115	±2.5	PASS
Band66	1.4MHz	QPSK	132322	6RB#0	NV	20	15.29	0.008762	±2.5	PASS
Band66	1.4MHz	QPSK	132322	6RB#0	NV	30	4.55	0.002607	±2.5	PASS
Band66	1.4MHz	QPSK	132322	6RB#0	NV	40	7.17	0.004109	±2.5	PASS
Band66	1.4MHz	QPSK	132322	6RB#0	NV	50	9.87	0.005656	±2.5	PASS

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

Band66	3MHz	QPSK	132322	15RB#0	NV	-30	-5.11	-0.002928	±2.5	PASS
Band66	3MHz	QPSK	132322	15RB#0	NV	-20	-4.41	-0.002527	±2.5	PASS
Band66	3MHz	QPSK	132322	15RB#0	NV	-10	-4.12	-0.002361	±2.5	PASS
Band66	3MHz	QPSK	132322	15RB#0	NV	0	4.61	0.002642	±2.5	PASS
Band66	3MHz	QPSK	132322	15RB#0	NV	10	-5.69	-0.003261	±2.5	PASS
Band66	3MHz	QPSK	132322	15RB#0	NV	20	6.38	0.003656	±2.5	PASS
Band66	3MHz	QPSK	132322	15RB#0	NV	30	6.65	0.003811	±2.5	PASS
Band66	3MHz	QPSK	132322	15RB#0	NV	40	3.40	0.001948	±2.5	PASS
Band66	3MHz	QPSK	132322	15RB#0	NV	50	9.04	0.005181	±2.5	PASS
Band66	5MHz	QPSK	132322	25RB#0	NV	-30	4.88	0.002797	±2.5	PASS
Band66	5MHz	QPSK	132322	25RB#0	NV	-20	4.02	0.002304	±2.5	PASS
Band66	5MHz	QPSK	132322	25RB#0	NV	-10	5.16	0.002957	±2.5	PASS
Band66	5MHz	QPSK	132322	25RB#0	NV	0	10.61	0.006080	±2.5	PASS
Band66	5MHz	QPSK	132322	25RB#0	NV	10	-2.02	-0.001158	±2.5	PASS
Band66	5MHz	QPSK	132322	25RB#0	NV	20	-5.25	-0.003009	±2.5	PASS
Band66	5MHz	QPSK	132322	25RB#0	NV	30	-2.16	-0.001238	±2.5	PASS
Band66	5MHz	QPSK	132322	25RB#0	NV	40	5.51	0.003158	±2.5	PASS
Band66	5MHz	QPSK	132322	25RB#0	NV	50	3.73	0.002138	±2.5	PASS
Band66	10MHz	QPSK	132322	50RB#0	NV	-30	7.35	0.004212	±2.5	PASS
Band66	10MHz	QPSK	132322	50RB#0	NV	-20	4.82	0.002762	±2.5	PASS
Band66	10MHz	QPSK	132322	50RB#0	NV	-10	5.31	0.003043	±2.5	PASS
Band66	10MHz	QPSK	132322	50RB#0	NV	0	7.88	0.004516	±2.5	PASS
Band66	10MHz	QPSK	132322	50RB#0	NV	10	9.36	0.005364	±2.5	PASS
Band66	10MHz	QPSK	132322	50RB#0	NV	20	9.93	0.005691	±2.5	PASS
Band66	10MHz	QPSK	132322	50RB#0	NV	30	8.65	0.004957	±2.5	PASS
Band66	10MHz	QPSK	132322	50RB#0	NV	40	8.05	0.004613	±2.5	PASS
Band66	10MHz	QPSK	132322	50RB#0	NV	50	6.39	0.003662	±2.5	PASS
Band66	15MHz	QPSK	132322	75RB#0	NV	-30	8.47	0.004854	±2.5	PASS
Band66	15MHz	QPSK	132322	75RB#0	NV	-20	6.31	0.003616	±2.5	PASS
Band66	15MHz	QPSK	132322	75RB#0	NV	-10	4.95	0.002837	±2.5	PASS
Band66	15MHz	QPSK	132322	75RB#0	NV	0	9.77	0.005599	±2.5	PASS
Band66	15MHz	QPSK	132322	75RB#0	NV	10	7.87	0.004510	±2.5	PASS
Band66	15MHz	QPSK	132322	75RB#0	NV	20	7.67	0.004395	±2.5	PASS
Band66	15MHz	QPSK	132322	75RB#0	NV	30	4.76	0.002728	±2.5	PASS
Band66	15MHz	QPSK	132322	75RB#0	NV	40	8.01	0.004590	±2.5	PASS
Band66	15MHz	QPSK	132322	75RB#0	NV	50	7.80	0.004470	±2.5	PASS
Band66	20MHz	QPSK	132322	100RB#0	NV	-30	10.63	0.006092	±2.5	PASS
Band66	20MHz	QPSK	132322	100RB#0	NV	-20	5.01	0.002871	±2.5	PASS
Band66	20MHz	QPSK	132322	100RB#0	NV	-10	8.54	0.004894	±2.5	PASS
Band66	20MHz	QPSK	132322	100RB#0	NV	0	7.31	0.004189	±2.5	PASS
Band66	20MHz	QPSK	132322	100RB#0	NV	10	14.10	0.008080	±2.5	PASS
Band66	20MHz	QPSK	132322	100RB#0	NV	20	8.07	0.004625	±2.5	PASS
Band66	20MHz	QPSK	132322	100RB#0	NV	30	8.61	0.004934	±2.5	PASS
Band66	20MHz	QPSK	132322	100RB#0	NV	40	6.92	0.003966	±2.5	PASS
Band66	20MHz	QPSK	132322	100RB#0	NV	50	6.45	0.003696	±2.5	PASS
Band71	5MHz	QPSK	133147	25RB#0	NV	-30	1.43	0.002149	±2.5	PASS
Band71	5MHz	QPSK	133147	25RB#0	NV	-20	-4.49	-0.006747	±2.5	PASS
Band71	5MHz	QPSK	133147	25RB#0	NV	-10	-3.91	-0.005875	±2.5	PASS

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

Band71	5MHz	QPSK	133147	25RB#0	NV	0	-6.44	-0.009677	±2.5	PASS
Band71	5MHz	QPSK	133147	25RB#0	NV	10	1.23	0.001848	±2.5	PASS
Band71	5MHz	QPSK	133147	25RB#0	NV	20	1.79	0.002690	±2.5	PASS
Band71	5MHz	QPSK	133147	25RB#0	NV	30	-2.32	-0.003486	±2.5	PASS
Band71	5MHz	QPSK	133147	25RB#0	NV	40	-3.08	-0.004628	±2.5	PASS
Band71	5MHz	QPSK	133147	25RB#0	NV	50	2.62	0.003937	±2.5	PASS
Band71	5MHz	QPSK	133297	25RB#0	NV	-30	2.29	0.003365	±2.5	PASS
Band71	5MHz	QPSK	133297	25RB#0	NV	-20	1.80	0.002645	±2.5	PASS
Band71	5MHz	QPSK	133297	25RB#0	NV	-10	4.66	0.006848	±2.5	PASS
Band71	5MHz	QPSK	133297	25RB#0	NV	0	1.30	0.001910	±2.5	PASS
Band71	5MHz	QPSK	133297	25RB#0	NV	10	-2.60	-0.003821	±2.5	PASS
Band71	5MHz	QPSK	133297	25RB#0	NV	20	3.48	0.005114	±2.5	PASS
Band71	5MHz	QPSK	133297	25RB#0	NV	30	4.53	0.006657	±2.5	PASS
Band71	5MHz	QPSK	133297	25RB#0	NV	40	4.56	0.006701	±2.5	PASS
Band71	5MHz	QPSK	133297	25RB#0	NV	50	-3.13	-0.004600	±2.5	PASS
Band71	5MHz	QPSK	133447	25RB#0	NV	-30	-3.79	-0.005449	±2.5	PASS
Band71	5MHz	QPSK	133447	25RB#0	NV	-20	-0.92	-0.001323	±2.5	PASS
Band71	5MHz	QPSK	133447	25RB#0	NV	-10	-2.03	-0.002919	±2.5	PASS
Band71	5MHz	QPSK	133447	25RB#0	NV	0	-3.85	-0.005536	±2.5	PASS
Band71	5MHz	QPSK	133447	25RB#0	NV	10	-6.68	-0.009605	±2.5	PASS
Band71	5MHz	QPSK	133447	25RB#0	NV	20	2.06	0.002962	±2.5	PASS
Band71	5MHz	QPSK	133447	25RB#0	NV	30	-5.21	-0.007491	±2.5	PASS
Band71	5MHz	QPSK	133447	25RB#0	NV	40	3.19	0.004587	±2.5	PASS
Band71	5MHz	QPSK	133447	25RB#0	NV	50	-3.40	-0.004889	±2.5	PASS
Band71	5MHz	16QAM	133147	25RB#0	NV	-30	-1.50	-0.002254	±2.5	PASS
Band71	5MHz	16QAM	133147	25RB#0	NV	-20	-1.80	-0.002705	±2.5	PASS
Band71	5MHz	16QAM	133147	25RB#0	NV	-10	-1.96	-0.002945	±2.5	PASS
Band71	5MHz	16QAM	133147	25RB#0	NV	0	-4.28	-0.006431	±2.5	PASS
Band71	5MHz	16QAM	133147	25RB#0	NV	10	-2.39	-0.003591	±2.5	PASS
Band71	5MHz	16QAM	133147	25RB#0	NV	20	1.10	0.001653	±2.5	PASS
Band71	5MHz	16QAM	133147	25RB#0	NV	30	3.26	0.004899	±2.5	PASS
Band71	5MHz	16QAM	133147	25RB#0	NV	40	-2.52	-0.003787	±2.5	PASS
Band71	5MHz	16QAM	133147	25RB#0	NV	50	2.75	0.004132	±2.5	PASS
Band71	5MHz	16QAM	133297	25RB#0	NV	-30	-4.01	-0.005893	±2.5	PASS
Band71	5MHz	16QAM	133297	25RB#0	NV	-20	-3.82	-0.005614	±2.5	PASS
Band71	5MHz	16QAM	133297	25RB#0	NV	-10	-3.38	-0.004967	±2.5	PASS
Band71	5MHz	16QAM	133297	25RB#0	NV	0	2.98	0.004379	±2.5	PASS
Band71	5MHz	16QAM	133297	25RB#0	NV	10	-4.01	-0.005893	±2.5	PASS
Band71	5MHz	16QAM	133297	25RB#0	NV	20	-3.91	-0.005746	±2.5	PASS
Band71	5MHz	16QAM	133297	25RB#0	NV	30	-4.42	-0.006495	±2.5	PASS
Band71	5MHz	16QAM	133297	25RB#0	NV	40	-4.39	-0.006451	±2.5	PASS
Band71	5MHz	16QAM	133297	25RB#0	NV	50	3.52	0.005173	±2.5	PASS
Band71	5MHz	16QAM	133447	25RB#0	NV	-30	-3.68	-0.005291	±2.5	PASS
Band71	5MHz	16QAM	133447	25RB#0	NV	-20	-6.21	-0.008929	±2.5	PASS
Band71	5MHz	16QAM	133447	25RB#0	NV	-10	-1.13	-0.001625	±2.5	PASS
Band71	5MHz	16QAM	133447	25RB#0	NV	0	-4.01	-0.005766	±2.5	PASS
Band71	5MHz	16QAM	133447	25RB#0	NV	10	-5.22	-0.007505	±2.5	PASS
Band71	5MHz	16QAM	133447	25RB#0	NV	20	-3.55	-0.005104	±2.5	PASS

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

Band71	5MHz	16QAM	133447	25RB#0	NV	30	-3.92	-0.005636	±2.5	PASS
Band71	5MHz	16QAM	133447	25RB#0	NV	40	-1.66	-0.002387	±2.5	PASS
Band71	5MHz	16QAM	133447	25RB#0	NV	50	-2.12	-0.003048	±2.5	PASS
Band71	10MHz	QPSK	133172	50RB#0	NV	-30	-3.19	-0.004775	±2.5	PASS
Band71	10MHz	QPSK	133172	50RB#0	NV	-20	-6.27	-0.009386	±2.5	PASS
Band71	10MHz	QPSK	133172	50RB#0	NV	-10	-4.56	-0.006826	±2.5	PASS
Band71	10MHz	QPSK	133172	50RB#0	NV	0	-6.02	-0.009012	±2.5	PASS
Band71	10MHz	QPSK	133172	50RB#0	NV	10	-8.47	-0.012680	±2.5	PASS
Band71	10MHz	QPSK	133172	50RB#0	NV	20	-3.23	-0.004835	±2.5	PASS
Band71	10MHz	QPSK	133172	50RB#0	NV	30	-6.95	-0.010404	±2.5	PASS
Band71	10MHz	QPSK	133172	50RB#0	NV	40	-4.63	-0.006931	±2.5	PASS
Band71	10MHz	QPSK	133172	50RB#0	NV	50	-5.62	-0.008413	±2.5	PASS
Band71	10MHz	QPSK	133297	50RB#0	NV	-30	-4.28	-0.006289	±2.5	PASS
Band71	10MHz	QPSK	133297	50RB#0	NV	-20	-5.91	-0.008685	±2.5	PASS
Band71	10MHz	QPSK	133297	50RB#0	NV	-10	-2.80	-0.004115	±2.5	PASS
Band71	10MHz	QPSK	133297	50RB#0	NV	0	-5.98	-0.008788	±2.5	PASS
Band71	10MHz	QPSK	133297	50RB#0	NV	10	1.37	0.002013	±2.5	PASS
Band71	10MHz	QPSK	133297	50RB#0	NV	20	-1.44	-0.002116	±2.5	PASS
Band71	10MHz	QPSK	133297	50RB#0	NV	30	-5.02	-0.007377	±2.5	PASS
Band71	10MHz	QPSK	133297	50RB#0	NV	40	-5.28	-0.007759	±2.5	PASS
Band71	10MHz	QPSK	133297	50RB#0	NV	50	1.39	0.002043	±2.5	PASS
Band71	10MHz	QPSK	133422	50RB#0	NV	-30	1.82	0.002626	±2.5	PASS
Band71	10MHz	QPSK	133422	50RB#0	NV	-20	1.46	0.002107	±2.5	PASS
Band71	10MHz	QPSK	133422	50RB#0	NV	-10	2.13	0.003074	±2.5	PASS
Band71	10MHz	QPSK	133422	50RB#0	NV	0	2.06	0.002973	±2.5	PASS
Band71	10MHz	QPSK	133422	50RB#0	NV	10	2.43	0.003506	±2.5	PASS
Band71	10MHz	QPSK	133422	50RB#0	NV	20	1.96	0.002828	±2.5	PASS
Band71	10MHz	QPSK	133422	50RB#0	NV	30	-5.54	-0.007994	±2.5	PASS
Band71	10MHz	QPSK	133422	50RB#0	NV	40	-1.30	-0.001876	±2.5	PASS
Band71	10MHz	QPSK	133422	50RB#0	NV	50	3.68	0.005310	±2.5	PASS
Band71	10MHz	16QAM	133172	50RB#0	NV	-30	-5.31	-0.007949	±2.5	PASS
Band71	10MHz	16QAM	133172	50RB#0	NV	-20	-5.62	-0.008413	±2.5	PASS
Band71	10MHz	16QAM	133172	50RB#0	NV	-10	-5.82	-0.008713	±2.5	PASS
Band71	10MHz	16QAM	133172	50RB#0	NV	0	-1.24	-0.001856	±2.5	PASS
Band71	10MHz	16QAM	133172	50RB#0	NV	10	-1.43	-0.002141	±2.5	PASS
Band71	10MHz	16QAM	133172	50RB#0	NV	20	-7.14	-0.010689	±2.5	PASS
Band71	10MHz	16QAM	133172	50RB#0	NV	30	-5.21	-0.007799	±2.5	PASS
Band71	10MHz	16QAM	133172	50RB#0	NV	40	-7.94	-0.011886	±2.5	PASS
Band71	10MHz	16QAM	133172	50RB#0	NV	50	-6.07	-0.009087	±2.5	PASS
Band71	10MHz	16QAM	133297	50RB#0	NV	-30	-4.42	-0.006495	±2.5	PASS
Band71	10MHz	16QAM	133297	50RB#0	NV	-20	-4.95	-0.007274	±2.5	PASS
Band71	10MHz	16QAM	133297	50RB#0	NV	-10	-6.04	-0.008876	±2.5	PASS
Band71	10MHz	16QAM	133297	50RB#0	NV	0	1.67	0.002454	±2.5	PASS
Band71	10MHz	16QAM	133297	50RB#0	NV	10	-5.28	-0.007759	±2.5	PASS
Band71	10MHz	16QAM	133297	50RB#0	NV	20	-4.15	-0.006098	±2.5	PASS
Band71	10MHz	16QAM	133297	50RB#0	NV	30	-5.14	-0.007553	±2.5	PASS
Band71	10MHz	16QAM	133297	50RB#0	NV	40	-7.82	-0.011492	±2.5	PASS
Band71	10MHz	16QAM	133297	50RB#0	NV	50	-6.25	-0.009184	±2.5	PASS

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

Band71	10MHz	16QAM	133422	50RB#0	NV	-30	2.60	0.003752	±2.5	PASS
Band71	10MHz	16QAM	133422	50RB#0	NV	-20	-4.49	-0.006479	±2.5	PASS
Band71	10MHz	16QAM	133422	50RB#0	NV	-10	2.26	0.003261	±2.5	PASS
Band71	10MHz	16QAM	133422	50RB#0	NV	0	-1.36	-0.001962	±2.5	PASS
Band71	10MHz	16QAM	133422	50RB#0	NV	10	3.42	0.004935	±2.5	PASS
Band71	10MHz	16QAM	133422	50RB#0	NV	20	-4.02	-0.005801	±2.5	PASS
Band71	10MHz	16QAM	133422	50RB#0	NV	30	2.78	0.004012	±2.5	PASS
Band71	10MHz	16QAM	133422	50RB#0	NV	40	-3.20	-0.004618	±2.5	PASS
Band71	10MHz	16QAM	133422	50RB#0	NV	50	-3.06	-0.004416	±2.5	PASS
Band71	15MHz	QPSK	133197	75RB#0	NV	-30	-3.19	-0.004758	±2.5	PASS
Band71	15MHz	QPSK	133197	75RB#0	NV	-20	-5.85	-0.008725	±2.5	PASS
Band71	15MHz	QPSK	133197	75RB#0	NV	-10	-6.01	-0.008963	±2.5	PASS
Band71	15MHz	QPSK	133197	75RB#0	NV	0	-3.25	-0.004847	±2.5	PASS
Band71	15MHz	QPSK	133197	75RB#0	NV	10	-4.03	-0.006010	±2.5	PASS
Band71	15MHz	QPSK	133197	75RB#0	NV	20	2.12	0.003162	±2.5	PASS
Band71	15MHz	QPSK	133197	75RB#0	NV	30	-5.98	-0.008919	±2.5	PASS
Band71	15MHz	QPSK	133197	75RB#0	NV	40	-6.37	-0.009500	±2.5	PASS
Band71	15MHz	QPSK	133197	75RB#0	NV	50	-3.49	-0.005205	±2.5	PASS
Band71	15MHz	QPSK	133297	75RB#0	NV	-30	-3.36	-0.004938	±2.5	PASS
Band71	15MHz	QPSK	133297	75RB#0	NV	-20	2.76	0.004056	±2.5	PASS
Band71	15MHz	QPSK	133297	75RB#0	NV	-10	-2.59	-0.003806	±2.5	PASS
Band71	15MHz	QPSK	133297	75RB#0	NV	0	-3.23	-0.004747	±2.5	PASS
Band71	15MHz	QPSK	133297	75RB#0	NV	10	-1.85	-0.002719	±2.5	PASS
Band71	15MHz	QPSK	133297	75RB#0	NV	20	-9.31	-0.013681	±2.5	PASS
Band71	15MHz	QPSK	133297	75RB#0	NV	30	-3.22	-0.004732	±2.5	PASS
Band71	15MHz	QPSK	133297	75RB#0	NV	40	-4.58	-0.006730	±2.5	PASS
Band71	15MHz	QPSK	133297	75RB#0	NV	50	-3.13	-0.004600	±2.5	PASS
Band71	15MHz	QPSK	133397	75RB#0	NV	-30	-2.15	-0.003114	±2.5	PASS
Band71	15MHz	QPSK	133397	75RB#0	NV	-20	-2.49	-0.003606	±2.5	PASS
Band71	15MHz	QPSK	133397	75RB#0	NV	-10	-3.88	-0.005619	±2.5	PASS
Band71	15MHz	QPSK	133397	75RB#0	NV	0	-1.53	-0.002216	±2.5	PASS
Band71	15MHz	QPSK	133397	75RB#0	NV	10	-4.03	-0.005836	±2.5	PASS
Band71	15MHz	QPSK	133397	75RB#0	NV	20	-2.25	-0.003259	±2.5	PASS
Band71	15MHz	QPSK	133397	75RB#0	NV	30	2.57	0.003722	±2.5	PASS
Band71	15MHz	QPSK	133397	75RB#0	NV	40	-4.36	-0.006314	±2.5	PASS
Band71	15MHz	QPSK	133397	75RB#0	NV	50	-4.33	-0.006271	±2.5	PASS
Band71	15MHz	16QAM	133197	75RB#0	NV	-30	-5.61	-0.008367	±2.5	PASS
Band71	15MHz	16QAM	133197	75RB#0	NV	-20	-2.53	-0.003773	±2.5	PASS
Band71	15MHz	16QAM	133197	75RB#0	NV	-10	-2.98	-0.004444	±2.5	PASS
Band71	15MHz	16QAM	133197	75RB#0	NV	0	-2.90	-0.004325	±2.5	PASS
Band71	15MHz	16QAM	133197	75RB#0	NV	10	-4.16	-0.006204	±2.5	PASS
Band71	15MHz	16QAM	133197	75RB#0	NV	20	-3.36	-0.005011	±2.5	PASS
Band71	15MHz	16QAM	133197	75RB#0	NV	30	-4.22	-0.006294	±2.5	PASS
Band71	15MHz	16QAM	133197	75RB#0	NV	40	-3.98	-0.005936	±2.5	PASS
Band71	15MHz	16QAM	133197	75RB#0	NV	50	-4.15	-0.006189	±2.5	PASS
Band71	15MHz	16QAM	133297	75RB#0	NV	-30	-4.38	-0.006436	±2.5	PASS
Band71	15MHz	16QAM	133297	75RB#0	NV	-20	-4.75	-0.006980	±2.5	PASS
Band71	15MHz	16QAM	133297	75RB#0	NV	-10	-3.82	-0.005614	±2.5	PASS

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

Band71	15MHz	16QAM	133297	75RB#0	NV	0	-5.68	-0.008347	±2.5	PASS
Band71	15MHz	16QAM	133297	75RB#0	NV	10	1.90	0.002792	±2.5	PASS
Band71	15MHz	16QAM	133297	75RB#0	NV	20	-5.09	-0.007480	±2.5	PASS
Band71	15MHz	16QAM	133297	75RB#0	NV	30	-5.89	-0.008655	±2.5	PASS
Band71	15MHz	16QAM	133297	75RB#0	NV	40	-4.58	-0.006730	±2.5	PASS
Band71	15MHz	16QAM	133297	75RB#0	NV	50	-3.82	-0.005614	±2.5	PASS
Band71	15MHz	16QAM	133397	75RB#0	NV	-30	-5.05	-0.007314	±2.5	PASS
Band71	15MHz	16QAM	133397	75RB#0	NV	-20	-2.30	-0.003331	±2.5	PASS
Band71	15MHz	16QAM	133397	75RB#0	NV	-10	-2.68	-0.003881	±2.5	PASS
Band71	15MHz	16QAM	133397	75RB#0	NV	0	-2.19	-0.003172	±2.5	PASS
Band71	15MHz	16QAM	133397	75RB#0	NV	10	2.02	0.002925	±2.5	PASS
Band71	15MHz	16QAM	133397	75RB#0	NV	20	-0.94	-0.001361	±2.5	PASS
Band71	15MHz	16QAM	133397	75RB#0	NV	30	-1.62	-0.002346	±2.5	PASS
Band71	15MHz	16QAM	133397	75RB#0	NV	40	-1.14	-0.001651	±2.5	PASS
Band71	15MHz	16QAM	133397	75RB#0	NV	50	-2.79	-0.004041	±2.5	PASS
Band71	20MHz	QPSK	133222	100RB#0	NV	-30	-3.55	-0.005275	±2.5	PASS
Band71	20MHz	QPSK	133222	100RB#0	NV	-20	2.99	0.004443	±2.5	PASS
Band71	20MHz	QPSK	133222	100RB#0	NV	-10	-3.98	-0.005914	±2.5	PASS
Band71	20MHz	QPSK	133222	100RB#0	NV	0	-2.73	-0.004056	±2.5	PASS
Band71	20MHz	QPSK	133222	100RB#0	NV	10	-3.49	-0.005186	±2.5	PASS
Band71	20MHz	QPSK	133222	100RB#0	NV	20	-4.25	-0.006315	±2.5	PASS
Band71	20MHz	QPSK	133222	100RB#0	NV	30	-3.58	-0.005319	±2.5	PASS
Band71	20MHz	QPSK	133222	100RB#0	NV	40	-2.73	-0.004056	±2.5	PASS
Band71	20MHz	QPSK	133222	100RB#0	NV	50	-2.88	-0.004279	±2.5	PASS
Band71	20MHz	QPSK	133322	100RB#0	NV	-30	3.75	0.005490	±2.5	PASS
Band71	20MHz	QPSK	133322	100RB#0	NV	-20	1.73	0.002533	±2.5	PASS
Band71	20MHz	QPSK	133322	100RB#0	NV	-10	-2.12	-0.003104	±2.5	PASS
Band71	20MHz	QPSK	133322	100RB#0	NV	0	2.95	0.004319	±2.5	PASS
Band71	20MHz	QPSK	133322	100RB#0	NV	10	-2.10	-0.003075	±2.5	PASS
Band71	20MHz	QPSK	133322	100RB#0	NV	20	-3.12	-0.004568	±2.5	PASS
Band71	20MHz	QPSK	133322	100RB#0	NV	30	2.22	0.003250	±2.5	PASS
Band71	20MHz	QPSK	133322	100RB#0	NV	40	-4.31	-0.006310	±2.5	PASS
Band71	20MHz	QPSK	133322	100RB#0	NV	50	-1.39	-0.002035	±2.5	PASS
Band71	20MHz	QPSK	133372	100RB#0	NV	-30	-5.85	-0.008503	±2.5	PASS
Band71	20MHz	QPSK	133372	100RB#0	NV	-20	-3.05	-0.004433	±2.5	PASS
Band71	20MHz	QPSK	133372	100RB#0	NV	-10	-2.27	-0.003299	±2.5	PASS
Band71	20MHz	QPSK	133372	100RB#0	NV	0	1.53	0.002224	±2.5	PASS
Band71	20MHz	QPSK	133372	100RB#0	NV	10	-4.94	-0.007180	±2.5	PASS
Band71	20MHz	QPSK	133372	100RB#0	NV	20	-1.60	-0.002326	±2.5	PASS
Band71	20MHz	QPSK	133372	100RB#0	NV	30	-5.18	-0.007529	±2.5	PASS
Band71	20MHz	QPSK	133372	100RB#0	NV	40	-4.31	-0.006265	±2.5	PASS
Band71	20MHz	QPSK	133372	100RB#0	NV	50	-4.94	-0.007180	±2.5	PASS
Band71	20MHz	16QAM	133222	100RB#0	NV	-30	4.38	0.006508	±2.5	PASS
Band71	20MHz	16QAM	133222	100RB#0	NV	-20	-2.45	-0.003640	±2.5	PASS
Band71	20MHz	16QAM	133222	100RB#0	NV	-10	-3.25	-0.004829	±2.5	PASS
Band71	20MHz	16QAM	133222	100RB#0	NV	0	-5.75	-0.008544	±2.5	PASS
Band71	20MHz	16QAM	133222	100RB#0	NV	10	-1.52	-0.002259	±2.5	PASS
Band71	20MHz	16QAM	133222	100RB#0	NV	20	-2.16	-0.003210	±2.5	PASS

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

Band71	20MHz	16QAM	133222	100RB#0	NV	30	-2.33	-0.003462	±2.5	PASS
Band71	20MHz	16QAM	133222	100RB#0	NV	40	5.19	0.007712	±2.5	PASS
Band71	20MHz	16QAM	133222	100RB#0	NV	50	-3.28	-0.004874	±2.5	PASS
Band71	20MHz	16QAM	133322	100RB#0	NV	-30	-6.65	-0.009736	±2.5	PASS
Band71	20MHz	16QAM	133322	100RB#0	NV	-20	3.52	0.005154	±2.5	PASS
Band71	20MHz	16QAM	133322	100RB#0	NV	-10	2.73	0.003997	±2.5	PASS
Band71	20MHz	16QAM	133322	100RB#0	NV	0	2.30	0.003367	±2.5	PASS
Band71	20MHz	16QAM	133322	100RB#0	NV	10	-2.78	-0.004070	±2.5	PASS
Band71	20MHz	16QAM	133322	100RB#0	NV	20	-3.71	-0.005432	±2.5	PASS
Band71	20MHz	16QAM	133322	100RB#0	NV	30	-4.61	-0.006750	±2.5	PASS
Band71	20MHz	16QAM	133322	100RB#0	NV	40	-5.55	-0.008126	±2.5	PASS
Band71	20MHz	16QAM	133322	100RB#0	NV	50	3.20	0.004685	±2.5	PASS
Band71	20MHz	16QAM	133372	100RB#0	NV	-30	-4.32	-0.006279	±2.5	PASS
Band71	20MHz	16QAM	133372	100RB#0	NV	-20	-4.33	-0.006294	±2.5	PASS
Band71	20MHz	16QAM	133372	100RB#0	NV	-10	-4.79	-0.006962	±2.5	PASS
Band71	20MHz	16QAM	133372	100RB#0	NV	0	-3.59	-0.005218	±2.5	PASS
Band71	20MHz	16QAM	133372	100RB#0	NV	10	-3.50	-0.005087	±2.5	PASS
Band71	20MHz	16QAM	133372	100RB#0	NV	20	-4.06	-0.005901	±2.5	PASS
Band71	20MHz	16QAM	133372	100RB#0	NV	30	-4.82	-0.007006	±2.5	PASS
Band71	20MHz	16QAM	133372	100RB#0	NV	40	2.53	0.003677	±2.5	PASS
Band71	20MHz	16QAM	133372	100RB#0	NV	50	-3.43	-0.004985	±2.5	PASS

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

9. RADIATED SPURIOUS EMISSIONS

LIMIT

FCC: §27.53 (m) LTE (B7/41)
At least 55+10 log (P) dB on all frequencies more than X megahertz from the channel edge, where X is the greater of 6 megahertz or the actual emission bandwidth as defined in paragraph (m)(6) of this section.

FCC: §27.53 (g) LTE (B12/71)
The power of any emission outside of the authorized operating frequency ranges must be attenuated below the transmitting power (P) by a factor of at least 43 +10 log (P) dB.

FCC: §27.53 LTE (B13)
(c) The power of any emission outside of the authorized operating frequency ranges must be attenuated below the transmitting power (P) by a factor of at least 43 + 10 l0g (P) dB.
(f) Emissions in the band 1559-1610 MHz shall be limited to -70 dBW/MHz equivalent isotropically radiated power (EIRP) for wideband signals, and -80 dBW ElRP for discrete emissions of less than 700 Hz bandwidth.

FCC: §24.238(a) LTE (B2/25)
The power of any emission outside of the authorized operating frequency ranges must be attenuated below the transmitting power (P) by a factor of at least 43 + 10 l0g (P) dB.

FCC: §90.691 LTE (B26)
The power of any emission outside of the authorized operating frequency ranges must be attenuated below the transmitting power (P) by a factor of at least 43 + 10 10g (P) dB.

FCC: §22.917(a) LTE (B5/26)
The power of any emission outside of the authorized operating frequency ranges must be attenuated below the transmitting power (P) by a factor of at least 43 + 10 10g (P) dB.

FCC: §27.53(h) LTE (B4/66)
The power of any emission outside of the authorized operating frequency ranges must be attenuated below the transmitting power (P) by a factor of at least 43 + 10 l0g (P) dB.

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

TEST PROCEDURE

Following the test configuration shown below, radiated emissions measured directly from the EUT and convert the measured field strength or received power to ERP or EIRP, as required, for comparison to the applicable limits. As stated in section 5.5.1 of ANSI C63.26-2015. The field strength measurement method by using a test site validated to the requirement of ANSI C63.4 is an alternative method to the substitution measurement.

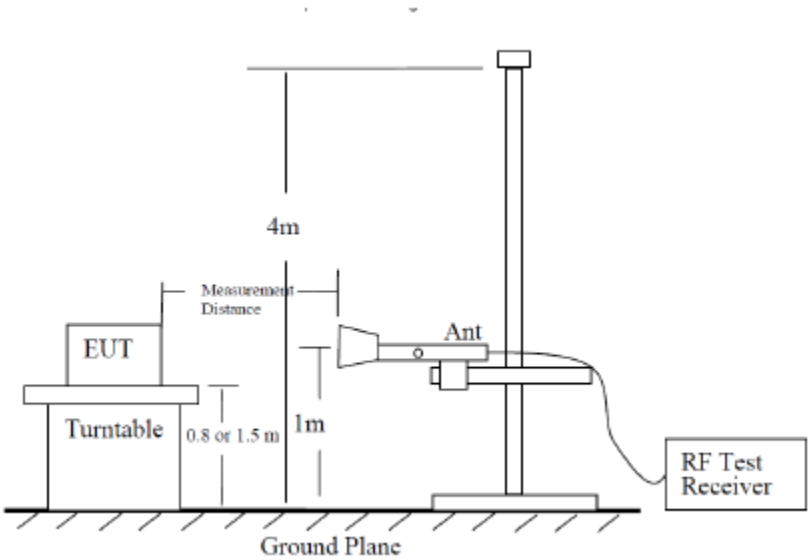

Radiated Power Measurement Calculation According to ANSI C63.26-2015

a) E (dBμV/m) = Measured amplitude level (dBμV) + Cable Loss (dB)+ Antenna Factor (dB/m).
b) E (dBμV/m) = Measured amplitude level (dBm) + 107 + Cable Loss (dB) + Antenna Factor (dB/m).
c) E (dBμV/m) = EIRP (dBm) -- 20l0g(D) + 104.8, where D is the measurement distance (in the far field region) in m.
d) EIRP (dBm) = E (dBμV/m) + 20l0g(D) - 104.8, where D is the measurement distance (in the far field region) in m.

So, from d)

The measuring distance is at 3m, then 20*Log (3) = 9.5424

Then, EIRP (dBm) = E (dBμV/m) + 9.5424 - 104.8 = E (dBμV/m) - 95.2576

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

X axis, Y axis, Z axis:

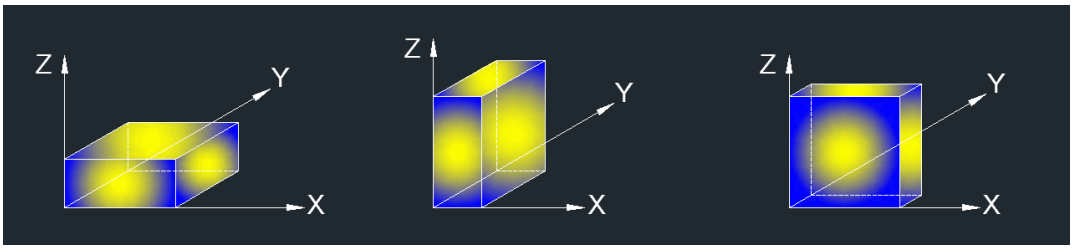

Note: The EUT was investigated in three orthogonal orientations X/Y/Z on ANT0 and ANT3 to determine the worst-case orientation. X orientation is finally determined the worst.

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

TEST ENVIRONMENT

Temperature	22.9°C	Relative Humidity	68.3%
Atmosphere Pressure	101kPa	Test Voltage	DC 3.87 V

RESULTS

9.1.1. LTE Band 2

QPSK-20 MHz-Low Channel- Horizontal

No.	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
1	5025.000	41.23	0.47	41.70	82.25	-40.55	peak
2	7890.000	38.85	6.31	45.16	82.25	-37.09	peak
3	9135.000	37.71	10.55	48.26	82.25	-33.99	peak
4	11400.000	37.20	16.23	53.43	82.25	-28.82	peak
5	13620.000	34.32	21.15	55.47	82.25	-26.78	peak
6	17970.000	29.91	25.51	55.42	82.25	-26.83	peak

QPSK-20 MHz-Low Channel-Vertical

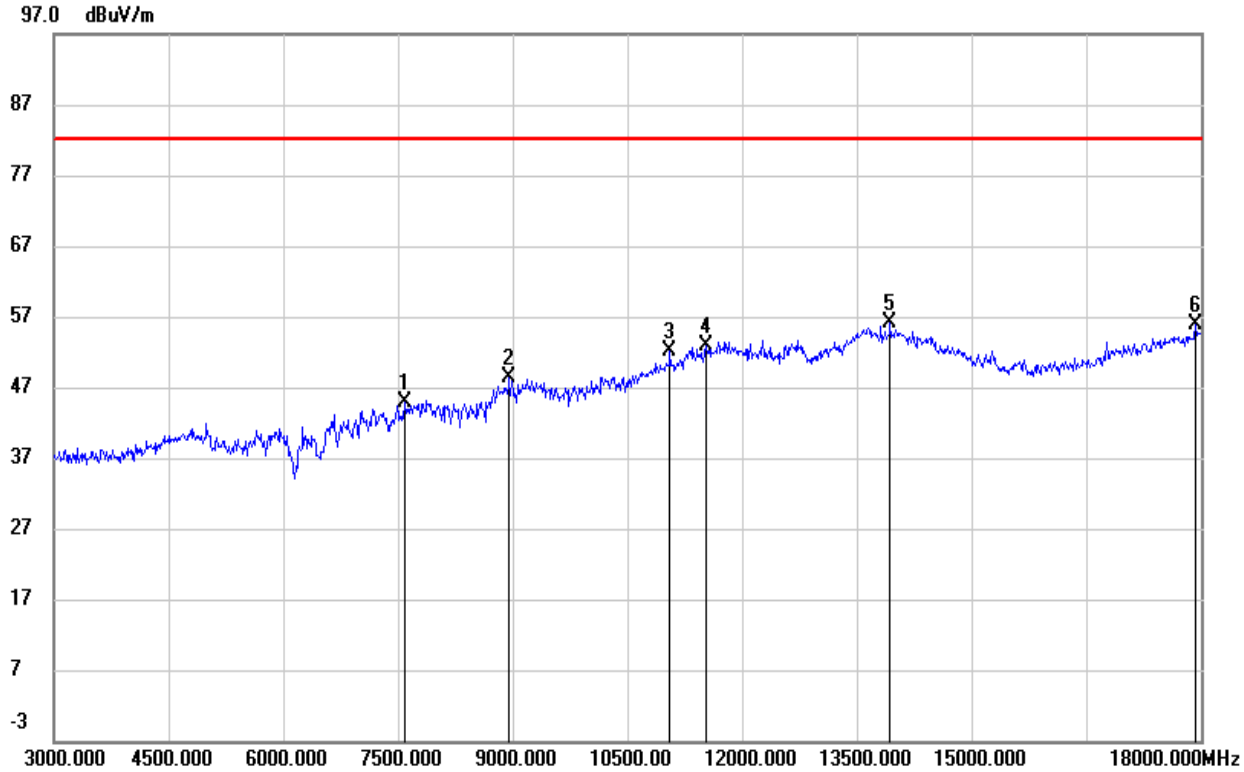

No.	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
1	7590.000	38.64	6.32	44.96	82.25	-37.29	peak
2	8955.000	38.10	10.16	48.26	82.25	-33.99	peak
3	11055.000	37.07	14.96	52.03	82.25	-30.22	peak
4	11520.000	36.17	16.65	52.82	82.25	-29.43	peak
5	13935.000	34.33	21.82	56.15	82.25	-26.10	peak
6	17925.000	30.51	25.25	55.76	82.25	-26.49	peak

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

QPSK-20 MHz-Mid Channel- Horizontal

No.	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
1	7755.000	39.46	6.31	45.77	82.25	-36.48	peak
2	9135.000	38.18	10.55	48.73	82.25	-33.52	peak
3	10605.000	35.53	13.37	48.90	82.25	-33.35	peak
4	11670.000	36.40	17.07	53.47	82.25	-28.78	peak
5	13845.000	34.34	21.62	55.96	82.25	-26.29	peak
6	17985.000	29.19	25.60	54.79	82.25	-27.46	peak

QPSK-20 MHz- Mid Channel-Vertical

No.	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
1	4800.000	42.18	-0.31	41.87	82.25	-40.38	peak
2	8385.000	38.83	6.72	45.55	82.25	-36.70	peak
3	9285.000	37.82	10.61	48.43	82.25	-33.82	peak
4	12300.000	37.18	17.74	54.92	82.25	-27.33	peak
5	14250.000	34.58	20.93	55.51	82.25	-26.74	peak
6	18000.000	29.10	25.69	54.79	82.25	-27.46	peak

QPSK-20 MHz-High Channel- Horizontal

No.	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
1	4785.000	41.87	-0.37	41.50	82.25	-40.75	peak
2	6660.000	38.81	5.02	43.83	82.25	-38.42	peak
3	9135.000	37.99	10.55	48.54	82.25	-33.71	peak
4	11775.000	36.14	17.35	53.49	82.25	-28.76	peak
5	13590.000	34.72	21.09	55.81	82.25	-26.44	peak
6	17985.000	30.43	25.60	56.03	82.25	-26.22	peak

QPSK-20 MHz- High Channel-Vertical

No.	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
1	4995.000	41.56	0.43	41.99	82.25	-40.26	peak
2	7755.000	38.88	6.31	45.19	82.25	-37.06	peak
3	9270.000	37.90	10.59	48.49	82.25	-33.76	peak
4	11745.000	36.02	17.27	53.29	82.25	-28.96	peak
5	13845.000	34.37	21.62	55.99	82.25	-26.26	peak
6	17970.000	30.47	25.51	55.98	82.25	-26.27	peak

Note: Limit= -13dBm+95.25=82.25 dBuV/m

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

9.1.2. LTE Band 4

QPSK-20 MHz-Low Channel- Horizontal

No.	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
1	4755.000	42.49	-0.48	42.01	82.25	-40.24	peak
2	7500.000	39.31	6.33	45.64	82.25	-36.61	peak
3	9060.000	37.24	10.51	47.75	82.25	-34.50	peak
4	11715.000	37.34	17.19	54.53	82.25	-27.72	peak
5	14040.000	34.20	21.79	55.99	82.25	-26.26	peak
6	17970.000	30.25	25.51	55.76	82.25	-26.49	peak

QPSK-20 MHz-Low Channel- Vertical

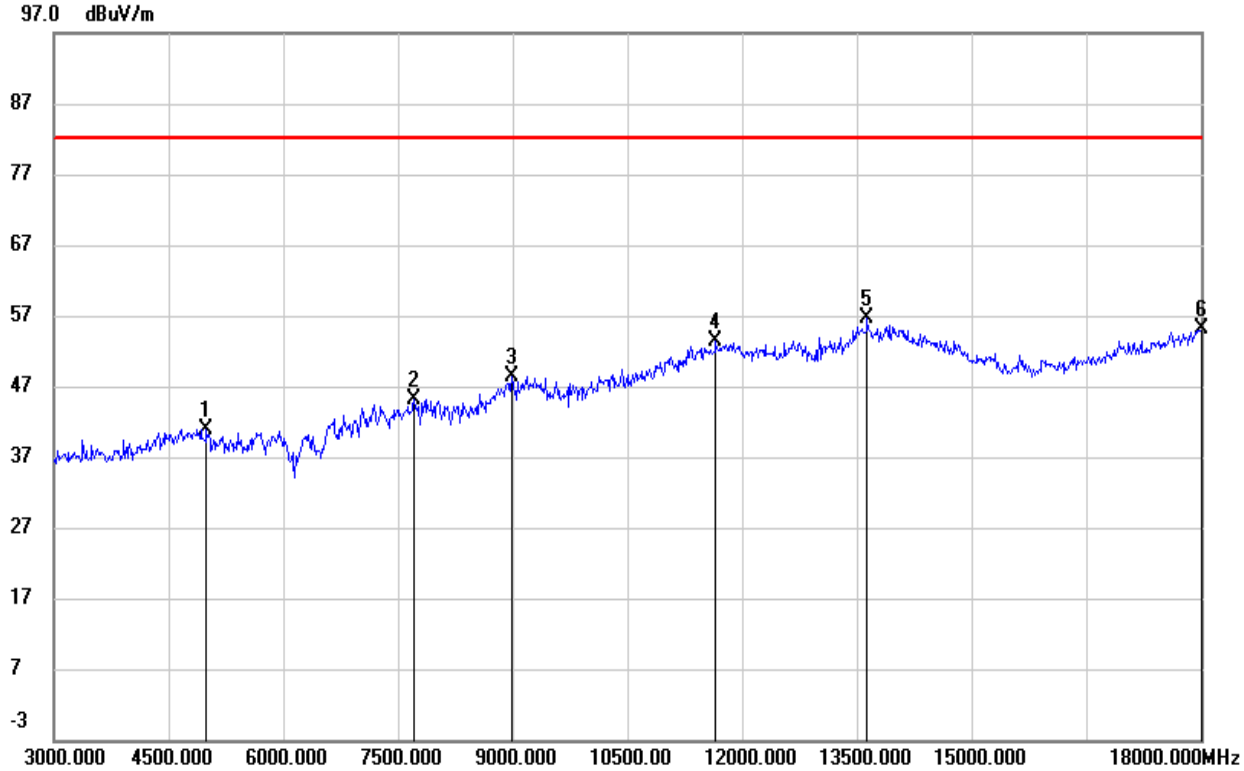

No.	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
1	4995.000	40.48	0.43	40.91	82.25	-41.34	peak
2	7710.000	38.83	6.33	45.16	82.25	-37.09	peak
3	8985.000	38.10	10.37	48.47	82.25	-33.78	peak
4	11655.000	36.44	17.01	53.45	82.25	-28.80	peak
5	13635.000	35.56	21.19	56.75	82.25	-25.50	peak
6	18000.000	29.40	25.69	55.09	82.25	-27.16	peak

QPSK-20 MHz-Mid Channel- Horizontal

No.	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
1	4785.000	41.25	-0.37	40.88	82.25	-41.37	peak
2	7725.000	38.53	6.32	44.85	82.25	-37.40	peak
3	9180.000	37.39	10.56	47.95	82.25	-34.30	peak
4	11745.000	36.74	17.27	54.01	82.25	-28.24	peak
5	13845.000	34.64	21.62	56.26	82.25	-25.99	peak
6	17985.000	30.36	25.60	55.96	82.25	-26.29	peak

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

QPSK-20 MHz-Mid Channel- Vertical

No.	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
1	4875.000	41.53	-0.03	41.50	82.25	-40.75	peak
2	7605.000	39.07	6.32	45.39	82.25	-36.86	peak
3	9060.000	37.47	10.51	47.98	82.25	-34.27	peak
4	11835.000	35.72	17.51	53.23	82.25	-29.02	peak
5	13920.000	34.25	21.79	56.04	82.25	-26.21	peak
6	17940.000	30.15	25.34	55.49	82.25	-26.76	peak

QPSK-20 MHz-High Channel- Horizontal

No.	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
1	4770.000	41.30	-0.43	40.87	82.25	-41.38	peak
2	8010.000	39.17	6.32	45.49	82.25	-36.76	peak
3	9225.000	37.80	10.58	48.38	82.25	-33.87	peak
4	11550.000	36.29	16.74	53.03	82.25	-29.22	peak
5	13575.000	34.82	21.06	55.88	82.25	-26.37	peak
6	17430.000	32.69	22.47	55.16	82.25	-27.09	peak

QPSK-20 MHz-High Channel- Vertical

No.	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
1	5085.000	43.84	0.52	44.36	82.25	-37.89	peak
2	9150.000	37.49	10.54	48.03	82.25	-34.22	peak
3	11760.000	36.05	17.31	53.36	82.25	-28.89	peak
4	12645.000	36.35	17.92	54.27	82.25	-27.98	peak
5	13620.000	34.38	21.15	55.53	82.25	-26.72	peak
6	18000.000	29.83	25.69	55.52	82.25	-26.73	peak

Note: Limit= -13dBm+95.25=82.25 dBuV/m

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

9.1.3. LTE Band 5

QPSK-10 MHz-Low Channel- Horizontal

No.	Frequency	Reading	Correct	Result	Limit	Margin	Remark
	(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
1	2494.000	45.75	-8.52	37.23	82.25	-45.02	peak
2	4114.000	42.66	-3.94	38.72	82.25	-43.53	peak
3	4879.000	41.28	-0.63	40.65	82.25	-41.60	peak
4	6670.000	37.92	4.57	42.49	82.25	-39.76	peak
5	7885.000	38.83	5.66	44.49	82.25	-37.76	peak
6	9136.000	37.78	9.80	47.58	82.25	-34.67	peak

QPSK-20 MHz-Low Channel- Vertical

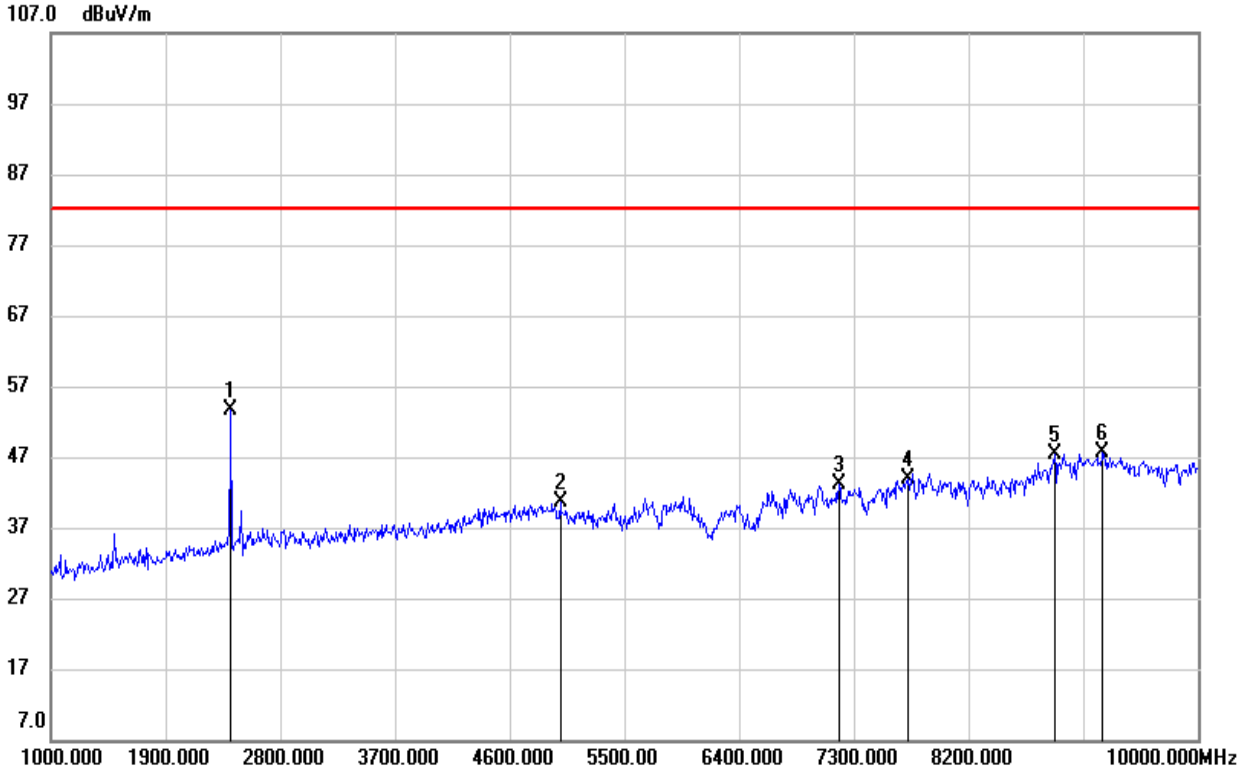

No.	Frequency	Reading	Correct	Result	Limit	Margin	Remark
	(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
1	2413.000	62.60	-8.94	53.66	82.25	-28.59	peak
2	4996.000	40.74	-0.17	40.57	82.25	-41.68	peak
3	7183.000	37.17	6.01	43.18	82.25	-39.07	peak
4	7723.000	38.27	5.67	43.94	82.25	-38.31	peak
5	8875.000	38.40	8.86	47.26	82.25	-34.99	peak
6	9253.000	37.71	9.83	47.54	82.25	-34.71	peak

QPSK-10 MHz-Mid Channel- Horizontal

No.	Frequency	Reading	Correct	Result	Limit	Margin	Remark
	(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
1	2836.000	44.81	-7.48	37.33	82.25	-44.92	peak
2	4951.000	41.62	-0.34	41.28	82.25	-40.97	peak
3	5572.000	40.36	0.63	40.99	82.25	-41.26	peak
4	6850.000	38.69	5.46	44.15	82.25	-38.10	peak
5	8605.000	37.67	6.98	44.65	82.25	-37.60	peak
6	9145.000	37.68	9.80	47.48	82.25	-34.77	peak

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

QPSK-10 MHz-Mid Channel- Vertical

No.	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
1	2476.000	52.84	-8.61	44.23	82.25	-38.02	peak
2	4897.000	49.67	-0.55	49.12	82.25	-33.13	peak
3	5905.000	39.33	1.58	40.91	82.25	-41.34	peak
4	7066.000	36.50	6.13	42.63	82.25	-39.62	peak
5	7768.000	38.52	5.66	44.18	82.25	-38.07	peak
6	9199.000	37.76	9.82	47.58	82.25	-34.67	peak

QPSK-10 MHz-High Channel- Horizontal

No.	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
1	1495.000	48.15	-12.74	35.41	82.25	-46.84	peak
2	2494.000	45.42	-8.52	36.90	82.25	-45.35	peak
3	4438.000	42.77	-2.42	40.35	82.25	-41.90	peak
4	7012.000	36.96	6.18	43.14	82.25	-39.11	peak
5	7732.000	38.79	5.68	44.47	82.25	-37.78	peak
6	8947.000	38.68	9.37	48.05	82.25	-34.20	peak

QPSK-10 MHz-High Channel- Vertical

No.	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
1	1495.000	49.43	-12.74	36.69	82.25	-45.56	peak
2	2494.000	48.92	-8.52	40.40	82.25	-41.85	peak
3	4996.000	41.50	-0.17	41.33	82.25	-40.92	peak
4	5671.000	40.21	0.91	41.12	82.25	-41.13	peak
5	7894.000	38.90	5.66	44.56	82.25	-37.69	peak
6	9190.000	38.18	9.81	47.99	82.25	-34.26	peak

Note: Limit= -13dBm+95.25=82.25 dBuV/m

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

9.1.4. LTE Band 7

QPSK-20 MHz-Low Channel- Horizontal

No.	Frequency	Reading	Correct	Result	Limit	Margin	Remark
	(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
1	4920.000	41.61	0.14	41.75	82.25	-40.50	peak
2	7755.000	38.51	6.31	44.82	82.25	-37.43	peak
3	9135.000	37.18	10.55	47.73	82.25	-34.52	peak
4	11745.000	35.95	17.27	53.22	82.25	-29.03	peak
5	13590.000	35.00	21.09	56.09	82.25	-26.16	peak
6	17970.000	29.56	25.51	55.07	82.25	-27.18	peak

QPSK-20 MHz-Low Channel- Vertical

No.	Frequency	Reading	Correct	Result	Limit	Margin	Remark
	(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
1	7305.000	38.26	6.47	44.73	70.25	-25.52	peak
2	9255.000	37.54	10.59	48.13	70.25	-22.12	peak
3	11025.000	37.26	14.85	52.11	70.25	-18.14	peak
4	11865.000	35.71	17.59	53.30	70.25	-16.95	peak
5	13920.000	33.93	21.79	55.72	70.25	-14.53	peak
6	17970.000	29.48	25.51	54.99	70.25	-15.26	peak

QPSK-20 MHz-Mid Channel- Horizontal

No.	Frequency	Reading	Correct	Result	Limit	Margin	Remark
	(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
1	6555.000	39.70	4.49	44.19	70.25	-26.06	peak
2	8985.000	37.42	10.37	47.79	70.25	-22.46	peak
3	10695.000	35.75	13.68	49.43	70.25	-20.82	peak
4	12360.000	35.50	17.69	53.19	70.25	-17.06	peak
5	13860.000	34.07	21.67	55.74	70.25	-14.51	peak
6	17970.000	30.08	25.51	55.59	70.25	-14.66	peak

QPSK-20 MHz-Mid Channel- Vertical

No.	Frequency	Reading	Correct	Result	Limit	Margin	Remark
	(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
1	6555.000	39.37	4.49	43.86	70.25	-26.39	peak
2	9135.000	37.54	10.55	48.09	70.25	-22.16	peak
3	10665.000	37.07	13.58	50.65	70.25	-19.60	peak
4	11715.000	35.96	17.19	53.15	70.25	-17.10	peak
5	13920.000	33.70	21.79	55.49	70.25	-14.76	peak
6	17955.000	29.59	25.42	55.01	70.25	-15.24	peak

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

QPSK-20 MHz-High Channel- Horizontal

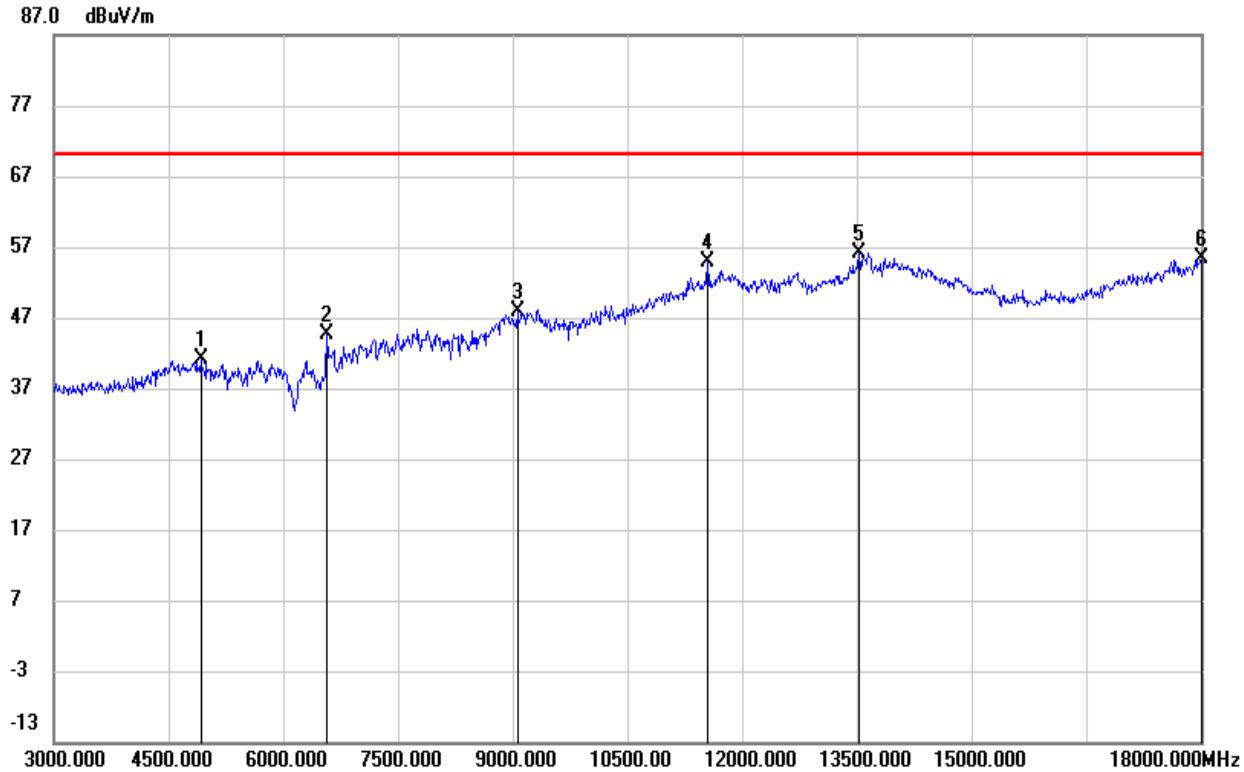

No.	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
1	4920.000	41.04	0.14	41.18	70.25	-29.07	peak
2	6570.000	40.11	4.57	44.68	70.25	-25.57	peak
3	9060.000	37.30	10.51	47.81	70.25	-22.44	peak
4	11550.000	38.19	16.74	54.93	70.25	-15.32	peak
5	13530.000	35.23	20.96	56.19	70.25	-14.06	peak
6	18000.000	29.76	25.69	55.45	70.25	-14.80	peak

QPSK-20 MHz-High Channel- Vertical

No.	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
1	4770.000	41.70	-0.43	41.27	70.25	-28.98	peak
2	6570.000	41.08	4.57	45.65	70.25	-24.60	peak
3	9195.000	37.91	10.56	48.47	70.25	-21.78	peak
4	11805.000	36.13	17.43	53.56	70.25	-16.69	peak
5	14100.000	34.17	21.55	55.72	70.25	-14.53	peak
6	17940.000	29.58	25.34	54.92	70.25	-15.33	peak

Note: Limit= -25dBm+95.25=70.25 dBuV/m

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

9.1.5. LTE Band 12

QPSK-10 MHz-Low Channel- Horizontal

No.	Frequency	Reading	Correct	Result	Limit	Margin	Remark
	(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
1	1405.000	48.95	-13.15	35.80	82.25	-46.45	peak
2	2116.000	64.11	-10.47	53.64	82.25	-28.61	peak
3	4834.000	41.86	-0.81	41.05	82.25	-41.20	peak
4	6670.000	37.96	4.57	42.53	82.25	-39.72	peak
5	7714.000	38.13	5.68	43.81	82.25	-38.44	peak
6	9073.000	37.51	9.77	47.28	82.25	-34.97	peak

QPSK-10 MHz-Low Channel- Vertical

No.	Frequency	Reading	Correct	Result	Limit	Margin	Remark
	(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
1	2116.000	57.56	-10.47	47.09	82.25	-35.16	peak
2	2494.000	48.35	-8.52	39.83	82.25	-42.42	peak
3	4996.000	41.29	-0.17	41.12	82.25	-41.13	peak
4	5932.000	39.65	1.65	41.30	82.25	-40.95	peak
5	7039.000	36.86	6.17	43.03	82.25	-39.22	peak
6	9352.000	37.55	9.88	47.43	82.25	-34.82	peak

QPSK-10 MHz-Mid Channel- Horizontal

No.	Frequency	Reading	Correct	Result	Limit	Margin	Remark
	(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
1	2125.000	64.15	-10.42	53.73	82.25	-28.52	peak
2	4879.000	40.87	-0.63	40.24	82.25	-42.01	peak
3	5716.000	39.77	1.04	40.81	82.25	-41.44	peak
4	7039.000	37.04	6.17	43.21	82.25	-39.04	peak
5	8038.000	39.76	5.69	45.45	82.25	-36.80	peak
6	9190.000	38.21	9.81	48.02	82.25	-34.23	peak

QPSK-10 MHz-Mid Channel- Vertical

No.	Frequency	Reading	Correct	Result	Limit	Margin	Remark
	(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
1	2125.000	57.38	-10.42	46.96	82.25	-35.29	peak
2	2494.000	47.84	-8.52	39.32	82.25	-42.93	peak
3	4996.000	41.82	-0.17	41.65	82.25	-40.60	peak
4	6670.000	38.40	4.57	42.97	82.25	-39.28	peak
5	7723.000	38.77	5.67	44.44	82.25	-37.81	peak
6	9145.000	38.16	9.80	47.96	82.25	-34.29	peak

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

QPSK-10 MHz-High Channel- Horizontal

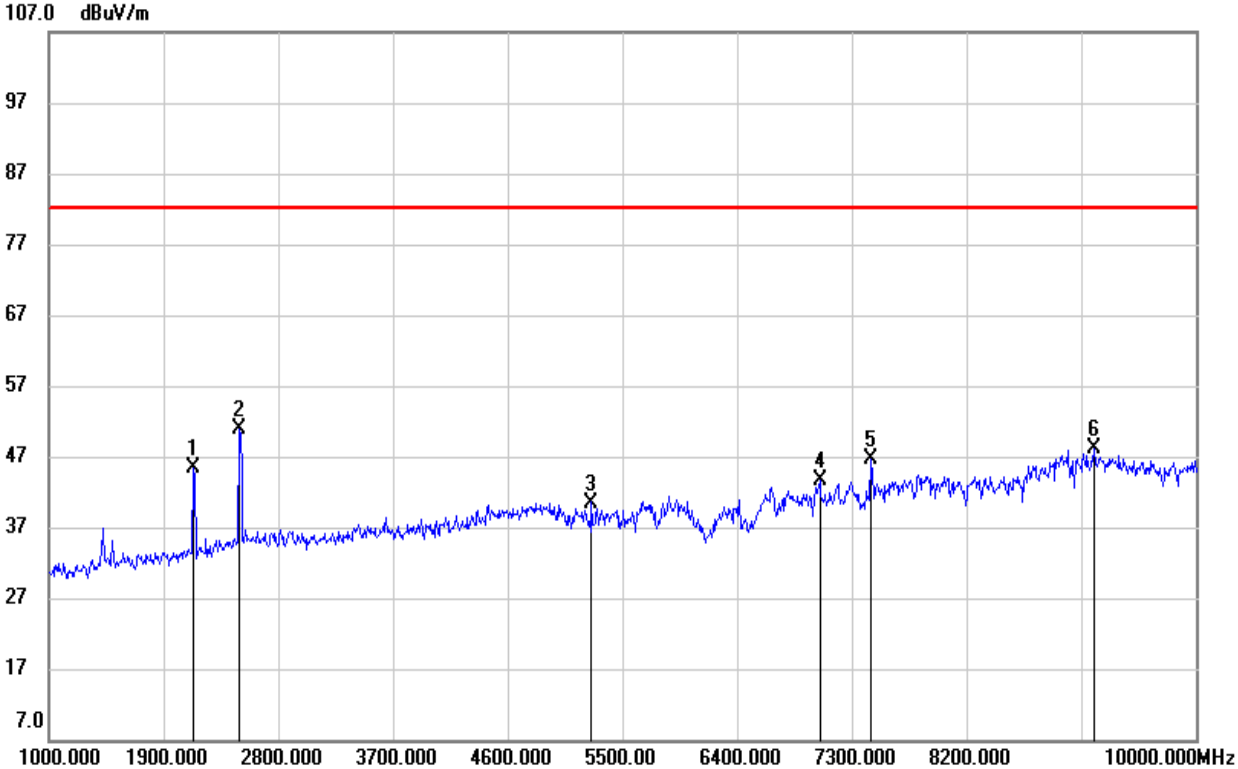

No.	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
1	2134.000	55.68	-10.37	45.31	82.25	-36.94	peak
2	2494.000	59.38	-8.52	50.86	82.25	-31.39	peak
3	5257.000	40.36	0.14	40.50	82.25	-41.75	peak
4	7048.000	37.49	6.16	43.65	82.25	-38.60	peak
5	7444.000	40.77	5.75	46.52	82.25	-35.73	peak
6	9199.000	38.30	9.82	48.12	82.25	-34.13	peak

QPSK-10 MHz-High Channel- Vertical

No.	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
1	2134.000	51.16	-10.37	40.79	82.25	-41.46	peak
2	2494.000	48.09	-8.52	39.57	82.25	-42.68	peak
3	4996.000	41.55	-0.17	41.38	82.25	-40.87	peak
4	6805.000	37.27	5.23	42.50	82.25	-39.75	peak
5	7885.000	38.99	5.66	44.65	82.25	-37.60	peak
6	9217.000	37.71	9.83	47.54	82.25	-34.71	peak

Note: Limit= -13dBm+95.25=82.25 dBuV/m

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

9.1.6. LTE Band 13

QPSK-10 MHz-Horizontal

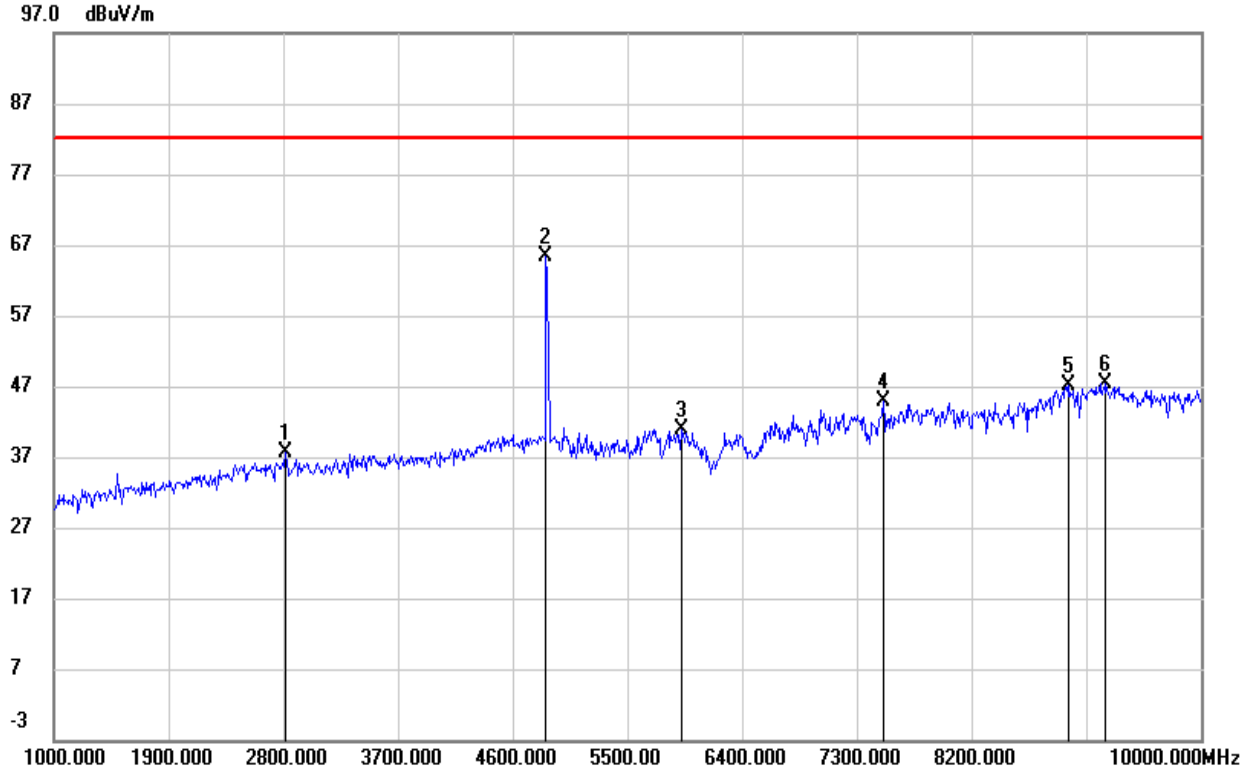

No.	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
1	2818.000	45.10	-7.53	37.57	82.25	-44.68	peak
2	4861.000	66.04	-0.70	65.34	82.25	-16.91	peak
3	5923.000	39.29	1.62	40.91	82.25	-41.34	peak
4	7507.000	39.26	5.69	44.95	82.25	-37.30	peak
5	8965.000	37.56	9.49	47.05	82.25	-35.20	peak
6	9253.000	37.65	9.83	47.48	82.25	-34.77	peak

QPSK-10 MHz-Vertical

No.	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
1	1495.000	49.68	-12.74	36.94	82.25	-45.31	peak
2	2494.000	47.68	-8.52	39.16	82.25	-43.09	peak
3	4879.000	42.00	-0.63	41.37	82.25	-40.88	peak
4	6796.000	37.18	5.19	42.37	82.25	-39.88	peak
5	7876.000	38.80	5.66	44.46	82.25	-37.79	peak
6	8974.000	38.00	9.56	47.56	82.25	-34.69	peak

Note: Limit= -13dBm+95.25=82.25 dBuV/m

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

9.1.7. LTE Band 25

QPSK-20 MHz-Low Channel- Horizontal

No.	Frequency	Reading	Correct	Result	Limit	Margin	Remark
	(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
1	4935.000	41.43	0.20	41.63	82.25	-40.62	peak
2	7755.000	39.51	6.31	45.82	82.25	-36.43	peak
3	9135.000	37.61	10.55	48.16	82.25	-34.09	peak
4	11535.000	36.44	16.70	53.14	82.25	-29.11	peak
5	13665.000	34.14	21.25	55.39	82.25	-26.86	peak
6	17970.000	30.39	25.51	55.90	82.25	-26.35	peak

QPSK-20 MHz-Low Channel- Vertical

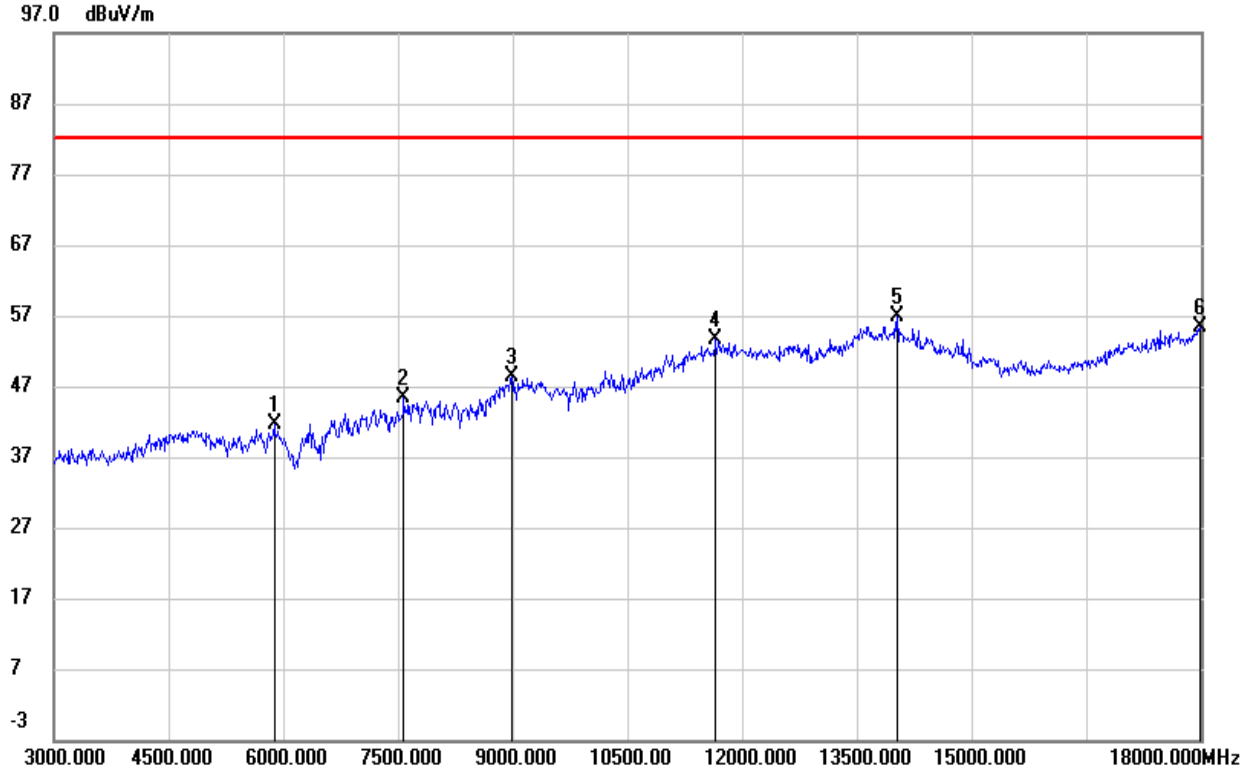

No.	Frequency	Reading	Correct	Result	Limit	Margin	Remark
	(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
1	5880.000	39.81	1.92	41.73	82.25	-40.52	peak
2	7575.000	39.04	6.32	45.36	82.25	-36.89	peak
3	8985.000	38.04	10.37	48.41	82.25	-33.84	peak
4	11655.000	36.73	17.01	53.74	82.25	-28.51	peak
5	14025.000	34.93	21.86	56.79	82.25	-25.46	peak
6	17985.000	29.77	25.60	55.37	82.25	-26.88	peak

QPSK-20 MHz-Mid Channel- Horizontal

No.	Frequency	Reading	Correct	Result	Limit	Margin	Remark
	(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
1	4830.000	41.95	-0.20	41.75	82.25	-40.50	peak
2	7170.000	38.64	6.56	45.20	82.25	-37.05	peak
3	9360.000	38.02	10.64	48.66	82.25	-33.59	peak
4	11730.000	36.41	17.22	53.63	82.25	-28.62	peak
5	13860.000	34.78	21.67	56.45	82.25	-25.80	peak
6	17985.000	29.66	25.60	55.26	82.25	-26.99	peak

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

QPSK-20 MHz-Mid Channel- Vertical

No.	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
1	4995.000	41.14	0.43	41.57	82.25	-40.68	peak
2	7755.000	39.26	6.31	45.57	82.25	-36.68	peak
3	9405.000	38.14	10.66	48.80	82.25	-33.45	peak
4	11880.000	36.10	17.63	53.73	82.25	-28.52	peak
5	13650.000	34.20	21.21	55.41	82.25	-26.84	peak
6	17970.000	29.49	25.51	55.00	82.25	-27.25	peak

QPSK-20 MHz-High Channel- Horizontal

No.	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
1	7245.000	37.62	6.51	44.13	82.25	-38.12	peak
2	8085.000	39.82	6.40	46.22	82.25	-36.03	peak
3	10860.000	37.33	14.27	51.60	82.25	-30.65	peak
4	11730.000	36.57	17.22	53.79	82.25	-28.46	peak
5	13620.000	34.41	21.15	55.56	82.25	-26.69	peak
6	17850.000	30.29	24.81	55.10	82.25	-27.15	peak

QPSK-20 MHz-High Channel- Vertical

No.	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
1	5865.000	40.25	1.88	42.13	82.25	-40.12	peak
2	8010.000	38.84	6.32	45.16	82.25	-37.09	peak
3	9150.000	37.26	10.54	47.80	82.25	-34.45	peak
4	11835.000	35.76	17.51	53.27	82.25	-28.98	peak
5	13860.000	33.90	21.67	55.57	82.25	-26.68	peak
6	17940.000	30.98	25.34	56.32	82.25	-25.93	peak

Note: Limit= -13dBm+95.25=82.25 dBuV/m

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

9.1.8. LTE Band 26 (814 ~ 824 MHz)

QPSK-10 MHz-Low Channel- Horizontal

No.	Frequency	Reading	Correct	Result	Limit	Margin	Remark
	(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
1	2494.000	45.23	-8.52	36.71	82.25	-45.54	peak
2	3727.000	43.78	-5.23	38.55	82.25	-43.70	peak
3	4951.000	41.47	-0.34	41.13	82.25	-41.12	peak
4	5707.000	40.35	1.01	41.36	82.25	-40.89	peak
5	7768.000	38.66	5.66	44.32	82.25	-37.93	peak
6	9262.000	37.57	9.84	47.41	82.25	-34.84	peak

QPSK-10 MHz-Low Channel- Vertical

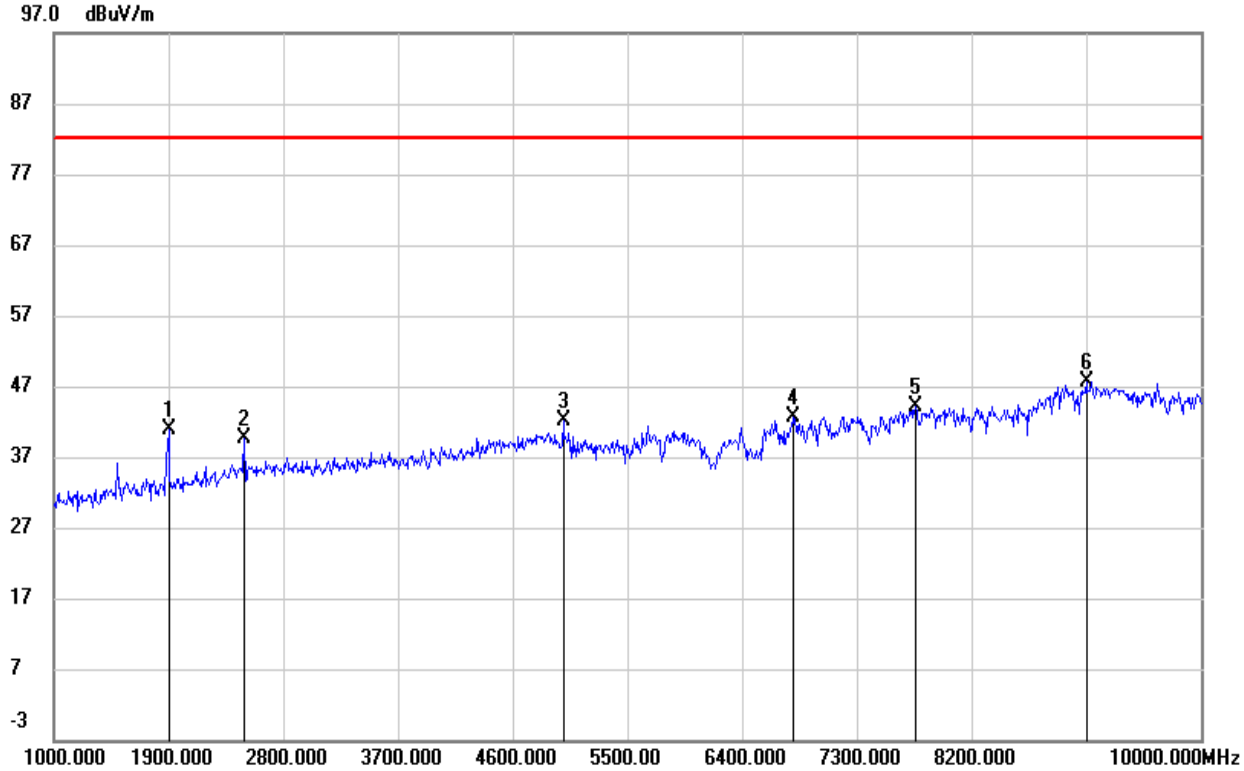

No.	Frequency	Reading	Correct	Result	Limit	Margin	Remark
	(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
1	1900.000	52.32	-11.39	40.93	82.25	-41.32	peak
2	2494.000	48.05	-8.52	39.53	82.25	-42.72	peak
3	4996.000	42.38	-0.17	42.21	82.25	-40.04	peak
4	6796.000	37.46	5.19	42.65	82.25	-39.60	peak
5	7759.000	38.42	5.67	44.09	82.25	-38.16	peak
6	9100.000	37.84	9.78	47.62	82.25	-34.63	peak

Note: Limit= -13dBm+95.25=82.25 dBuV/m

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

9.1.9. LTE Band 26 (824 ~ 849 MHz)

QPSK-15 MHz-Low Channel- Horizontal

No.	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
1	1891.000	48.24	-11.42	36.82	82.25	-45.43	peak
2	3682.000	43.76	-5.36	38.40	82.25	-43.85	peak
3	4996.000	41.16	-0.17	40.99	82.25	-41.26	peak
4	6841.000	36.81	5.40	42.21	82.25	-40.04	peak
5	7885.000	38.57	5.66	44.23	82.25	-38.02	peak
6	9244.000	37.46	9.83	47.29	82.25	-34.96	peak

QPSK-15 MHz-Low Channel- Vertical

No.	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
1	2494.000	47.73	-8.52	39.21	82.25	-43.04	peak
2	4996.000	41.05	-0.17	40.88	82.25	-41.37	peak
3	6796.000	37.47	5.19	42.66	82.25	-39.59	peak
4	7039.000	37.09	6.17	43.26	82.25	-38.99	peak
5	7714.000	38.62	5.68	44.30	82.25	-37.95	peak
6	8992.000	37.68	9.68	47.36	82.25	-34.89	peak

QPSK-15 MHz-Mid Channel- Horizontal

No.	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
1	3196.000	44.06	-6.54	37.52	82.25	-44.73	peak
2	4834.000	41.76	-0.81	40.95	82.25	-41.30	peak
3	7039.000	37.03	6.17	43.20	82.25	-39.05	peak
4	7903.000	39.21	5.66	44.87	82.25	-37.38	peak
5	9190.000	37.93	9.81	47.74	82.25	-34.51	peak
6	9964.000	36.16	11.06	47.22	82.25	-35.03	peak

QPSK-15 MHz-Mid Channel- Vertical

No.	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
1	2494.000	48.20	-8.52	39.68	82.25	-42.57	peak
2	4195.000	42.85	-3.56	39.29	82.25	-42.96	peak
3	4996.000	41.58	-0.17	41.41	82.25	-40.84	peak
4	6670.000	38.27	4.57	42.84	82.25	-39.41	peak
5	7831.000	39.63	5.67	45.30	82.25	-36.95	peak
6	9064.000	37.51	9.76	47.27	82.25	-34.98	peak

QPSK-15 MHz-High Channel- Horizontal

No.	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
1	2494.000	46.12	-8.52	37.60	82.25	-44.65	peak
2	4843.000	41.27	-0.78	40.49	82.25	-41.76	peak
3	6013.000	39.16	1.90	41.06	82.25	-41.19	peak
4	7192.000	37.83	6.00	43.83	82.25	-38.42	peak
5	7822.000	38.74	5.66	44.40	82.25	-37.85	peak
6	8938.000	37.42	9.31	46.73	82.25	-35.52	peak

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

QPSK-15 MHz-High Channel- Vertical

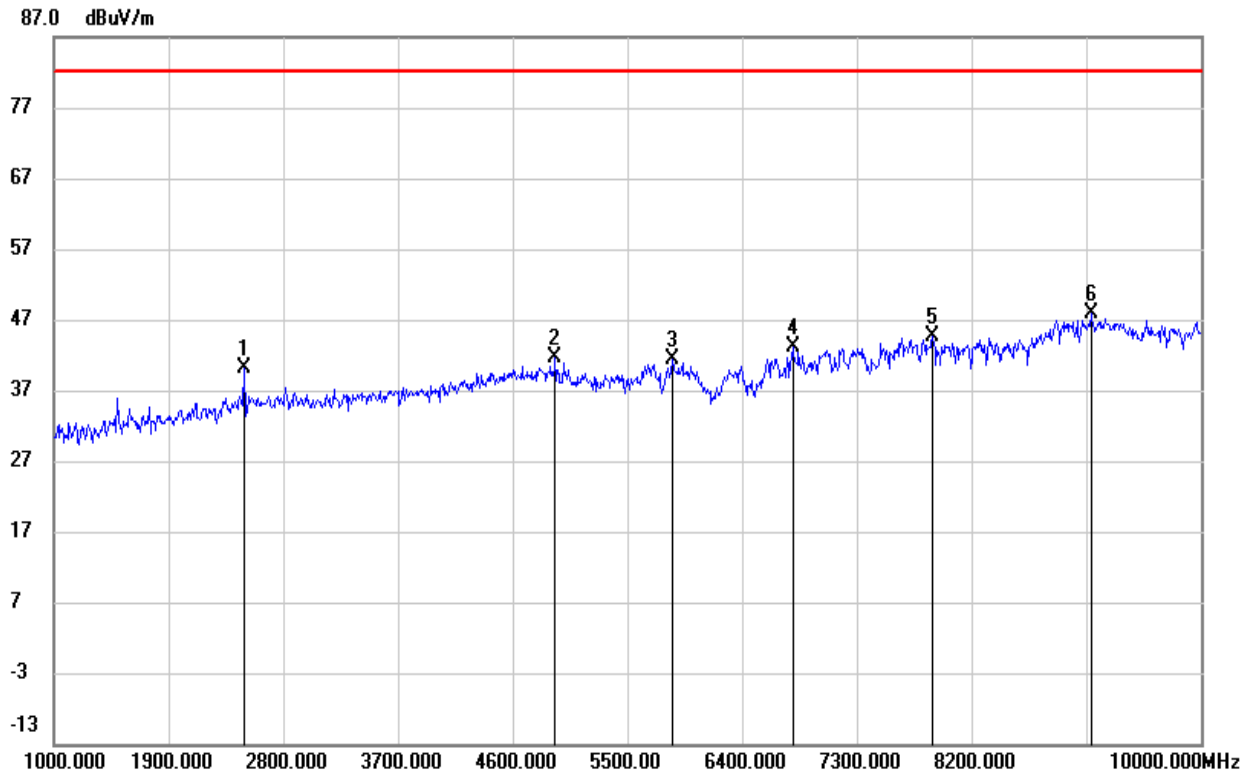

No.	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
1	2494.000	48.57	-8.52	40.05	82.25	-42.20	peak
2	4933.000	42.06	-0.42	41.64	82.25	-40.61	peak
3	5851.000	39.86	1.43	41.29	82.25	-40.96	peak
4	6796.000	38.05	5.19	43.24	82.25	-39.01	peak
5	7894.000	39.08	5.66	44.74	82.25	-37.51	peak
6	9136.000	37.98	9.80	47.78	82.25	-34.47	peak

Note: Limit= -13dBm+95.25=82.25 dBuV/m

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

9.1.10. LTE Band 41

QPSK-20 MHz-Low Channel- Horizontal

No.	Frequency	Reading	Correct	Result	Limit	Margin	Remark
	(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
1	7035.000	37.38	6.67	44.05	70.25	-26.20	peak
2	8340.000	38.34	6.66	45.00	70.25	-25.25	peak
3	9240.000	37.51	10.58	48.09	70.25	-22.16	peak
4	11640.000	36.22	16.98	53.20	70.25	-17.05	peak
5	14085.000	33.97	21.61	55.58	70.25	-14.67	peak
6	17940.000	29.82	25.34	55.16	70.25	-15.09	peak

QPSK-20 MHz-Low Channel- Vertical

No.	Frequency	Reading	Correct	Result	Limit	Margin	Remark
	(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
1	7500.000	38.68	6.33	45.01	70.25	-25.24	peak
2	10230.000	37.09	12.46	49.55	70.25	-20.70	peak
3	11745.000	35.51	17.27	52.78	70.25	-17.47	peak
4	12810.000	35.46	18.30	53.76	70.25	-16.49	peak
5	13800.000	33.49	21.54	55.03	70.25	-15.22	peak
6	17970.000	29.22	25.51	54.73	70.25	-15.52	peak

QPSK-20 MHz-Mid Channel- Horizontal

No.	Frequency	Reading	Correct	Result	Limit	Margin	Remark
	(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
1	4875.000	41.16	-0.03	41.13	70.25	-29.12	peak
2	7710.000	38.46	6.33	44.79	70.25	-25.46	peak
3	9135.000	37.24	10.55	47.79	70.25	-22.46	peak
4	11655.000	36.17	17.01	53.18	70.25	-17.07	peak
5	13920.000	33.63	21.79	55.42	70.25	-14.83	peak
6	17940.000	29.69	25.34	55.03	70.25	-15.22	peak

QPSK-20 MHz-Mid Channel- Vertical

No.	Frequency	Reading	Correct	Result	Limit	Margin	Remark
	(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
1	7770.000	39.47	6.31	45.78	70.25	-24.47	peak
2	9240.000	37.37	10.58	47.95	70.25	-22.30	peak
3	11415.000	35.57	16.29	51.86	70.25	-18.39	peak
4	12675.000	36.44	17.99	54.43	70.25	-15.82	peak
5	13650.000	33.77	21.21	54.98	70.25	-15.27	peak
6	17940.000	29.86	25.34	55.20	70.25	-15.05	peak

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

QPSK-20 MHz-High Channel- Horizontal

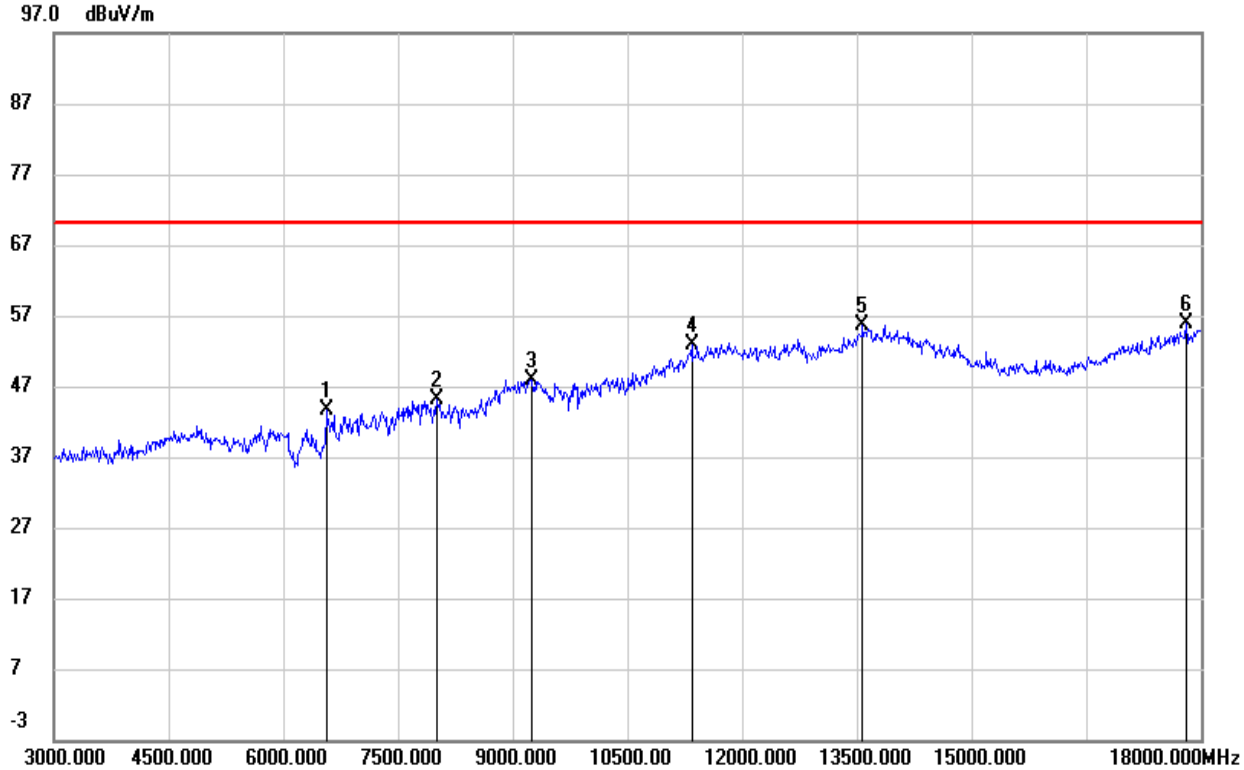

No.	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
1	6570.000	39.03	4.57	43.60	70.25	-26.65	peak
2	8010.000	38.77	6.32	45.09	70.25	-25.16	peak
3	9255.000	37.35	10.59	47.94	70.25	-22.31	peak
4	11340.000	36.94	16.01	52.95	70.25	-17.30	peak
5	13575.000	34.56	21.06	55.62	70.25	-14.63	peak
6	17805.000	31.31	24.54	55.85	70.25	-14.40	peak

QPSK-20 MHz-High Channel- Vertical

No.	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
1	6570.000	39.84	4.57	44.41	70.25	-25.84	peak
2	8025.000	39.71	6.34	46.05	70.25	-24.20	peak
3	10215.000	36.45	12.43	48.88	70.25	-21.37	peak
4	12285.000	35.27	17.75	53.02	70.25	-17.23	peak
5	13455.000	34.42	20.71	55.13	70.25	-15.12	peak
6	17940.000	30.30	25.34	55.64	70.25	-14.61	peak

Note: Limit= -25dBm+95.25=70.25 dBuV/m

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

9.1.11. LTE Band 66

QPSK-20 MHz-Low Channel- Horizontal

No.	Frequency	Reading	Correct	Result	Limit	Margin	Remark
	(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
1	5970.000	39.25	2.17	41.42	82.25	-40.83	peak
2	8025.000	38.25	6.34	44.59	82.25	-37.66	peak
3	9060.000	37.83	10.51	48.34	82.25	-33.91	peak
4	11745.000	35.96	17.27	53.23	82.25	-29.02	peak
5	13965.000	33.54	21.89	55.43	82.25	-26.82	peak
6	17970.000	29.59	25.51	55.10	82.25	-27.15	peak

QPSK-20 MHz-Low Channel- Vertical

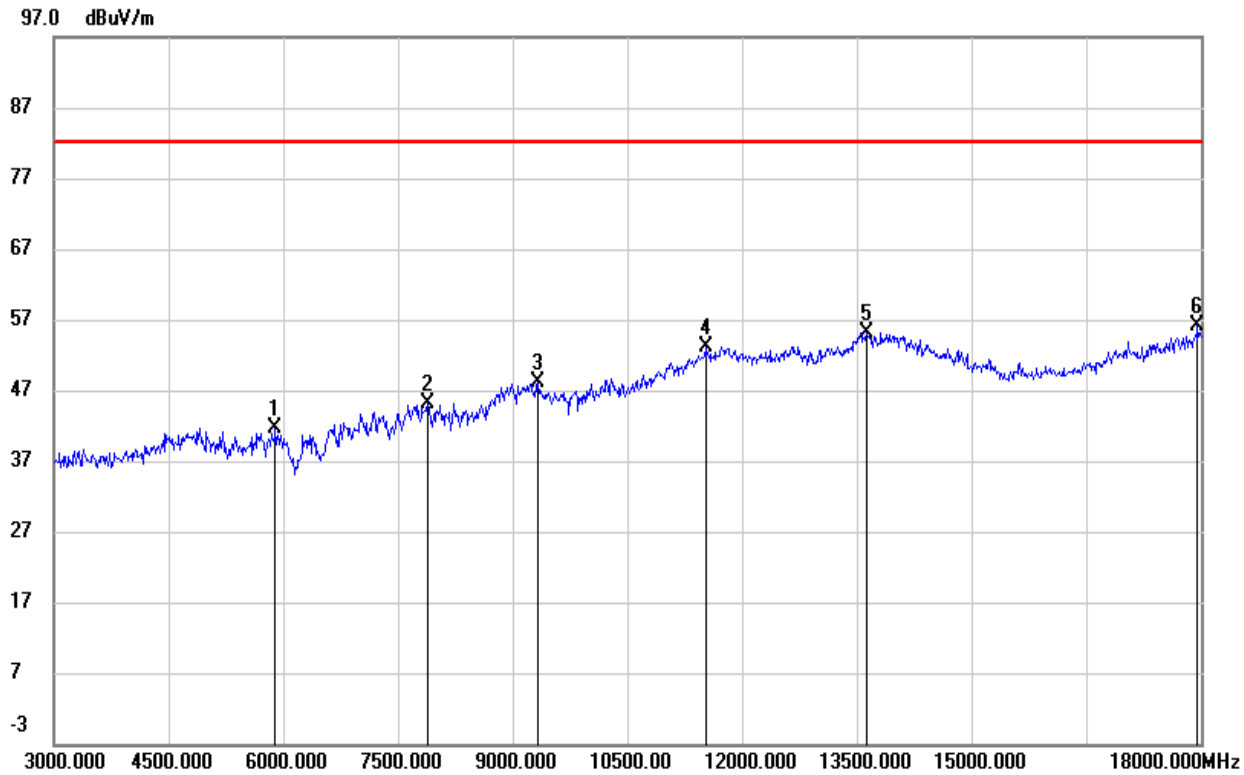

No.	Frequency	Reading	Correct	Result	Limit	Margin	Remark
	(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
1	5895.000	39.73	1.96	41.69	82.25	-40.56	peak
2	7890.000	38.89	6.31	45.20	82.25	-37.05	peak
3	9330.000	37.52	10.62	48.14	82.25	-34.11	peak
4	11520.000	36.47	16.65	53.12	82.25	-29.13	peak
5	13635.000	34.00	21.19	55.19	82.25	-27.06	peak
6	17955.000	30.63	25.42	56.05	82.25	-26.20	peak

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

QPSK-20 MHz-Mid Channel- Horizontal

No.	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
1	4665.000	41.95	-0.83	41.12	82.25	-41.13	peak
2	7185.000	37.44	6.55	43.99	82.25	-38.26	peak
3	9060.000	37.72	10.51	48.23	82.25	-34.02	peak
4	11400.000	36.53	16.23	52.76	82.25	-29.49	peak
5	13755.000	33.79	21.45	55.24	82.25	-27.01	peak
6	17940.000	30.36	25.34	55.70	82.25	-26.55	peak

QPSK-20 MHz-Mid Channel- Vertical

No.	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
1	6660.000	38.69	5.02	43.71	82.25	-38.54	peak
2	7710.000	37.96	6.33	44.29	82.25	-37.96	peak
3	9135.000	38.15	10.55	48.70	82.25	-33.55	peak
4	11640.000	36.84	16.98	53.82	82.25	-28.43	peak
5	13770.000	34.05	21.47	55.52	82.25	-26.73	peak
6	17985.000	29.57	25.60	55.17	82.25	-27.08	peak

QPSK-20 MHz-High Channel- Horizontal

No.	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
1	8040.000	38.79	6.34	45.13	82.25	-37.12	peak
2	9240.000	38.10	10.58	48.68	82.25	-33.57	peak
3	11895.000	35.51	17.68	53.19	82.25	-29.06	peak
4	13560.000	34.26	21.04	55.30	82.25	-26.95	peak
5	14445.000	35.31	20.14	55.45	82.25	-26.80	peak
6	17385.000	32.45	22.31	54.76	82.25	-27.49	peak

QPSK-20 MHz-High Channel- Vertical

No.	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
1	4890.000	41.52	0.03	41.55	82.25	-40.70	peak
2	7485.000	38.40	6.34	44.74	82.25	-37.51	peak
3	9300.000	37.45	10.61	48.06	82.25	-34.19	peak
4	11295.000	36.91	15.85	52.76	82.25	-29.49	peak
5	13665.000	34.37	21.25	55.62	82.25	-26.63	peak
6	17955.000	30.10	25.42	55.52	82.25	-26.73	peak

Note: Limit= -13dBm+95.25=82.25 dBuV/m

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

9.1.12. LTE Band 71

QPSK-20 MHz-Low Channel- Horizontal

No.	Frequency	Reading	Correct	Result	Limit	Margin	Remark
	(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
1	2017.000	52.11	-10.98	41.13	82.25	-41.12	peak
2	4888.000	41.26	-0.60	40.66	82.25	-41.59	peak
3	6931.000	37.23	5.86	43.09	82.25	-39.16	peak
4	7183.000	37.41	6.01	43.42	82.25	-38.83	peak
5	7759.000	38.83	5.67	44.50	82.25	-37.75	peak
6	9244.000	37.28	9.83	47.11	82.25	-35.14	peak

QPSK-20 MHz-Low Channel- Vertical

No.	Frequency	Reading	Correct	Result	Limit	Margin	Remark
	(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
1	1495.000	49.15	-12.74	36.41	82.25	-45.84	peak
2	2017.000	47.75	-10.98	36.77	82.25	-45.48	peak
3	2494.000	48.58	-8.52	40.06	82.25	-42.19	peak
4	4996.000	41.81	-0.17	41.64	82.25	-40.61	peak
5	7309.000	37.32	5.88	43.20	82.25	-39.05	peak
6	9190.000	38.00	9.81	47.81	82.25	-34.44	peak

QPSK-20 MHz-Mid Channel- Horizontal

No.	Frequency	Reading	Correct	Result	Limit	Margin	Remark
	(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
1	2044.000	51.33	-10.84	40.49	82.25	-41.76	peak
2	2494.000	45.86	-8.52	37.34	82.25	-44.91	peak
3	4888.000	42.16	-0.60	41.56	82.25	-40.69	peak
4	7039.000	36.96	6.17	43.13	82.25	-39.12	peak
5	7885.000	39.22	5.66	44.88	82.25	-37.37	peak
6	8992.000	37.75	9.68	47.43	82.25	-34.82	peak

QPSK-20 MHz-Mid Channel- Vertical

No.	Frequency	Reading	Correct	Result	Limit	Margin	Remark
	(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
1	2494.000	48.83	-8.52	40.31	82.25	-41.94	peak
2	4483.000	42.52	-2.21	40.31	82.25	-41.94	peak
3	6841.000	36.96	5.40	42.36	82.25	-39.89	peak
4	7489.000	37.92	5.70	43.62	82.25	-38.63	peak
5	7894.000	39.17	5.66	44.83	82.25	-37.42	peak
6	9262.000	37.71	9.84	47.55	82.25	-34.70	peak

QPSK-20 MHz-High Channel- Horizontal

No.	Frequency	Reading	Correct	Result	Limit	Margin	Remark
	(MHz)	(dBuV)	(dB/m)	(dBuV/m)	(dBuV/m)	(dB)	
1	2062.000	49.19	-10.75	38.44	82.25	-43.81	peak
2	2494.000	46.52	-8.52	38.00	82.25	-44.25	peak
3	4753.000	42.30	-1.13	41.17	82.25	-41.08	peak
4	6634.000	38.27	4.38	42.65	82.25	-39.60	peak
5	7759.000	38.89	5.67	44.56	82.25	-37.69	peak
6	9217.000	37.69	9.83	47.52	82.25	-34.73	peak

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

QPSK-20 MHz-High Channel- Vertical

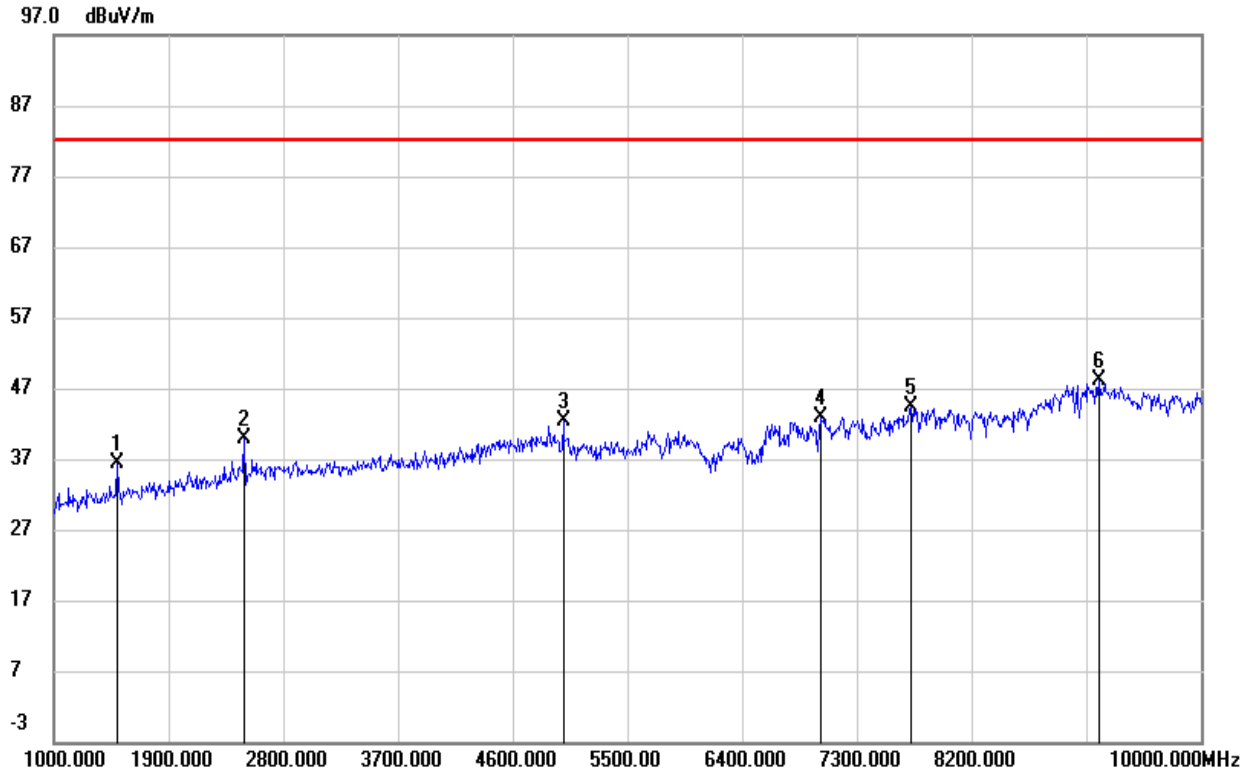

No.	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
1	1495.000	49.12	-12.74	36.38	82.25	-45.87	peak
2	2494.000	48.34	-8.52	39.82	82.25	-42.43	peak
3	4996.000	42.47	-0.17	42.30	82.25	-39.95	peak
4	7012.000	36.61	6.18	42.79	82.25	-39.46	peak
5	7723.000	38.60	5.67	44.27	82.25	-37.98	peak
6	9199.000	38.26	9.82	48.08	82.25	-34.17	peak

Note: Limit= -13dBm+95.25=82.25 dBuV/m

END OF REPORT

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch