Band66-20MHz-QPSK-132322-100RB#0

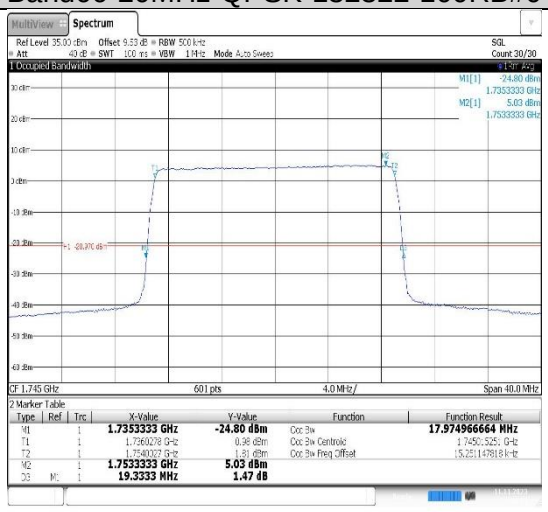

Band66-20MHz-16QAM-132322-100RB#0

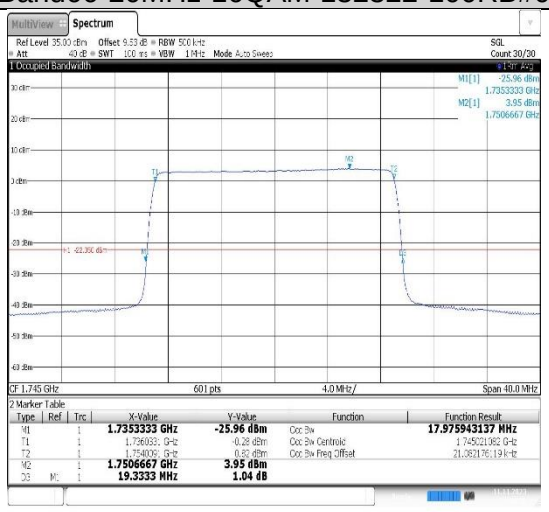

Band71-5MHz-QPSK-133297-25RB#0

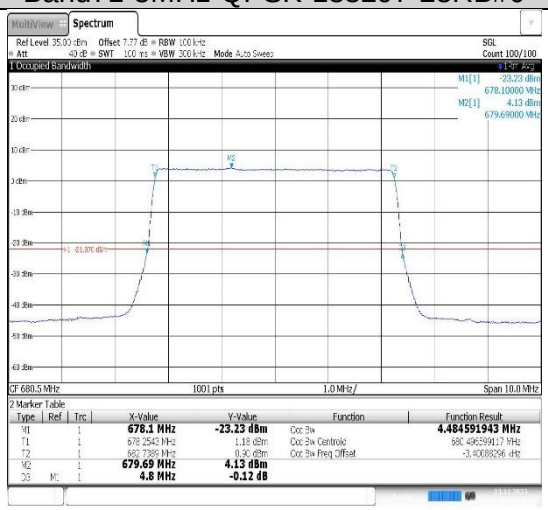

Band71-5MHz-16QAM-133297-25RB#0

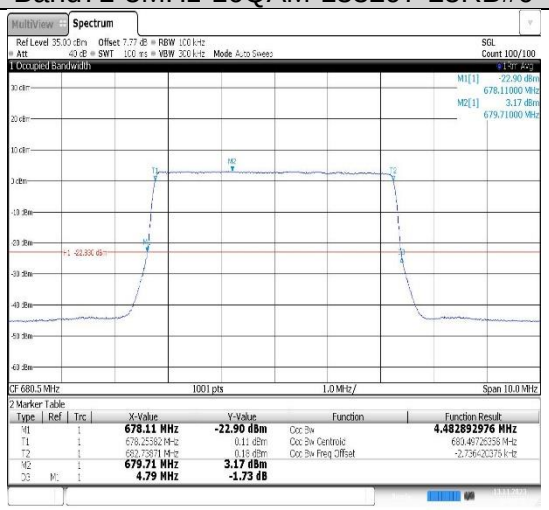

Band71-10MHz-QPSK-133297-50RB#0

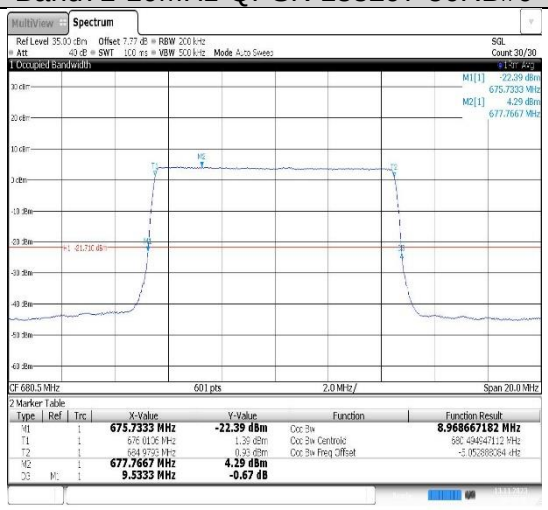

Band71-10MHz-16QAM-133297-50RB#0

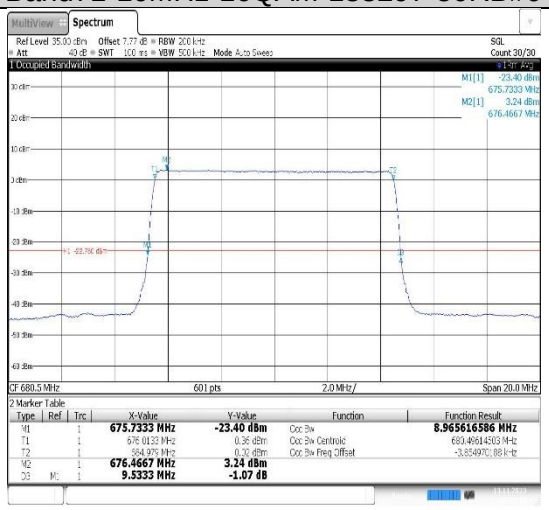

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

Band71-15MHz-QPSK-133297-75RB#0	Band71-15MHz-16QAM-133297-75RB#0
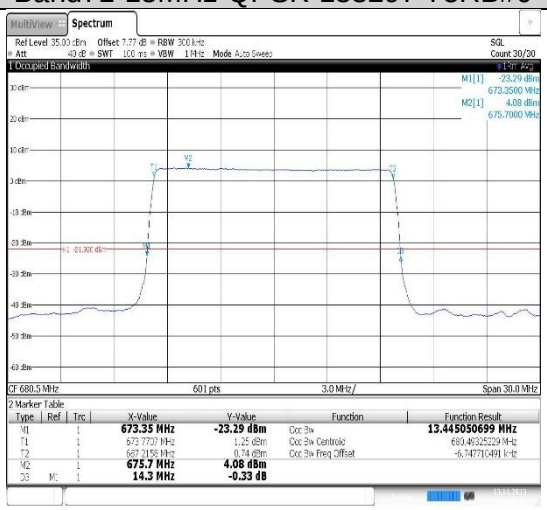	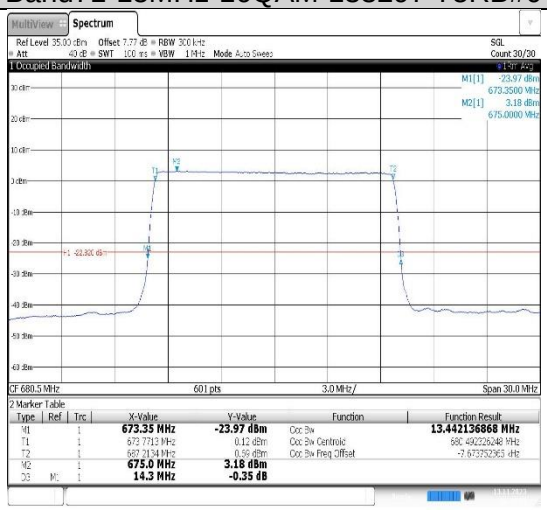
16:51:26 13.11.2023	16:51:34 13.11.2023
Band71-20MHz-QPSK-133322-100RB#0	**Band71-20MHz-16QAM-133322-100RB#0**
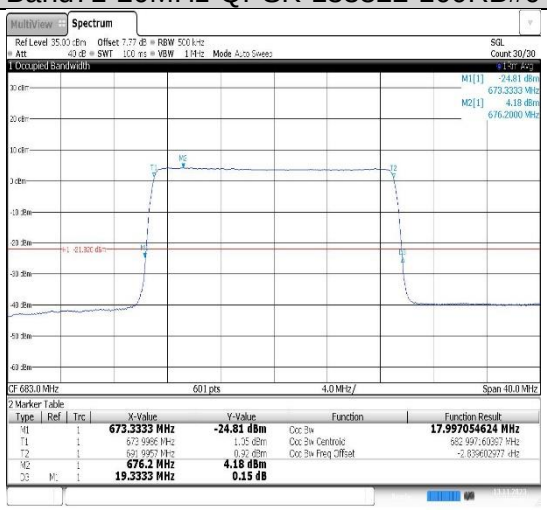	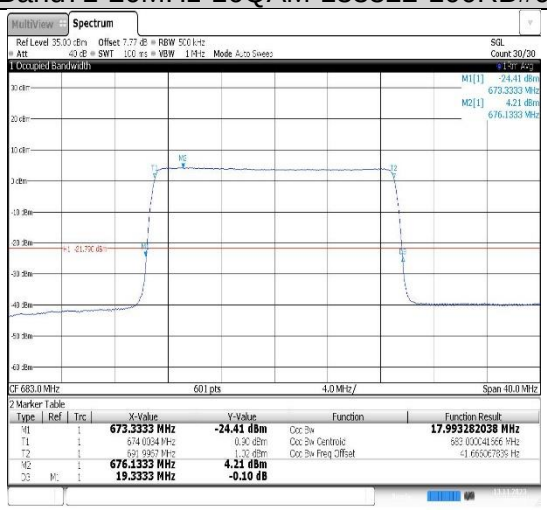
17:13:43 13.11.2023	17:13:50 13.11.2023

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

8.4. Appendix D: Band Edge

8.4.1. Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dBm)	Verdict
Band2	1.4MHz	QPSK	18607	1RB#0	-52.47,-25.63	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	-48.98,-33.71	PASS
Band2	1.4MHz	QPSK	19193	1RB#5	-24.57,-53.64	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	-31.54,-46.78	PASS
Band2	1.4MHz	16QAM	18607	1RB#0	-53.83,-26.39	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	-49.04,-33.68	PASS
Band2	1.4MHz	16QAM	19193	1RB#5	-24.97,-55.03	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	-32.84,-47.81	PASS
Band2	3MHz	QPSK	18615	1RB#0	-52.45,-52.98,-24.23	PASS
Band2	3MHz	QPSK	18615	15RB#0	-47.43,-35.55	PASS
Band2	3MHz	QPSK	19185	1RB#14	-23.03,-52.83,-54.87	PASS
Band2	3MHz	QPSK	19185	15RB#0	-33.82,-41.19	PASS
Band2	3MHz	16QAM	18615	1RB#0	-54.21,-54.40,-24.91	PASS
Band2	3MHz	16QAM	18615	15RB#0	-47.25,-36.72	PASS
Band2	3MHz	16QAM	19185	1RB#14	-24.76,-54.69,-55.59	PASS
Band2	3MHz	16QAM	19185	15RB#0	-35.48,-43.28	PASS
Band2	5MHz	QPSK	18625	1RB#0	-50.22,-50.98,-21.45	PASS
Band2	5MHz	QPSK	18625	25RB#0	-46.73,-34.18	PASS
Band2	5MHz	QPSK	19175	1RB#24	-21.42,-50.25,-53.20	PASS
Band2	5MHz	QPSK	19175	25RB#0	-33.55,-40.65	PASS
Band2	5MHz	16QAM	18625	1RB#0	-51.68,-52.83,-22.02	PASS
Band2	5MHz	16QAM	18625	25RB#0	-46.64,-35.46	PASS
Band2	5MHz	16QAM	19175	1RB#24	-22.12,-52.19,-54.27	PASS
Band2	5MHz	16QAM	19175	25RB#0	-34.35,-42.37	PASS
Band2	10MHz	QPSK	18650	1RB#0	-49.59,-28.21,-47.55	PASS
Band2	10MHz	QPSK	18650	50RB#0	-48.91,-42.64	PASS
Band2	10MHz	QPSK	19150	1RB#49	-27.17,-50.06,-52.50,-55.08,-57.01	PASS
Band2	10MHz	QPSK	19150	50RB#0	-39.56,-43.05	PASS
Band2	10MHz	16QAM	18650	1RB#0	-51.08,-28.91	PASS
Band2	10MHz	16QAM	18650	50RB#0	-49.37,-44.12	PASS
Band2	10MHz	16QAM	19150	1RB#49	-27.43,-47.63,-48.61,-49.14,-49.37,-53.77,-55.49,-58.25	PASS
Band2	10MHz	16QAM	19150	50RB#0	-41.20,-44.67	PASS
Band2	15MHz	QPSK	18675	1RB#0	-44.77,-46.80,-47.84,-22.05	PASS
Band2	15MHz	QPSK	18675	75RB#0	-44.06,-38.45	PASS
Band2	15MHz	QPSK	19125	1RB#74	-22.45,-27.52,-28.55,-28.65,-30.64,-34.20,-37.77,-38.16,-46.51,-47.70,-49.34	PASS
Band2	15MHz	QPSK	19125	75RB#0	-33.87,-36.79	PASS

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

Band2	15MHz	16QAM	18675	1RB#0	-45.85,-47.44,-23.51,-26.93,-28.65,-36.16,-36.66	PASS
Band2	15MHz	16QAM	18675	75RB#0	-44.61,-39.77	PASS
Band2	15MHz	16QAM	19125	1RB#74	-24.39,-47.50,-47.76,-48.39	PASS
Band2	15MHz	16QAM	19125	75RB#0	-36.49,-39.48	PASS
Band2	20MHz	QPSK	18700	1RB#0	-45.87,-52.08,-27.70,-35.86	PASS
Band2	20MHz	QPSK	18700	100RB#0	-45.94,-41.79	PASS
Band2	20MHz	QPSK	19100	1RB#99	-26.42,-32.80,-46.97,-49.36	PASS
Band2	20MHz	QPSK	19100	100RB#0	-38.27,-40.49	PASS
Band2	20MHz	16QAM	18700	1RB#0	-46.82,-28.28	PASS
Band2	20MHz	16QAM	18700	100RB#0	-46.40,-43.36	PASS
Band2	20MHz	16QAM	19100	1RB#99	-27.09,-47.70,-51.99	PASS
Band2	20MHz	16QAM	19100	100RB#0	-40.01,-42.37	PASS
Band4	1.4MHz	QPSK	19957	1RB#0	-50.86,-24.61	PASS
Band4	1.4MHz	QPSK	19957	6RB#0	-47.00,-33.43	PASS
Band4	1.4MHz	QPSK	20393	1RB#5	-25.75,-50.27	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	-33.67,-47.46	PASS
Band4	1.4MHz	16QAM	19957	1RB#0	-52.43,-25.64	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	-47.97,-33.64	PASS
Band4	1.4MHz	16QAM	20393	1RB#5	-26.26,-52.08	PASS
Band4	1.4MHz	16QAM	20393	6RB#0	-35.09,-48.91	PASS
Band4	3MHz	QPSK	19965	1RB#0	-51.74,-53.73,-23.26	PASS
Band4	3MHz	QPSK	19965	15RB#0	-47.25,-35.58	PASS
Band4	3MHz	QPSK	20385	1RB#14	-23.97,-50.00,-56.17	PASS
Band4	3MHz	QPSK	20385	15RB#0	-36.96,-45.70	PASS
Band4	3MHz	16QAM	19965	1RB#0	-53.27,-53.93,-24.50	PASS
Band4	3MHz	16QAM	19965	15RB#0	-47.04,-35.65	PASS
Band4	3MHz	16QAM	20385	1RB#14	-24.44,-51.91,-56.77	PASS
Band4	3MHz	16QAM	20385	15RB#0	-38.31,-47.14	PASS
Band4	5MHz	QPSK	19975	1RB#0	-49.30,-51.38,-20.79	PASS
Band4	5MHz	QPSK	19975	25RB#0	-46.44,-35.03	PASS
Band4	5MHz	QPSK	20375	1RB#24	-21.50,-47.49,-53.13,-55.48	PASS
Band4	5MHz	QPSK	20375	25RB#0	-35.20,-44.31	PASS
Band4	5MHz	16QAM	19975	1RB#0	-51.11,-52.40,-21.08	PASS
Band4	5MHz	16QAM	19975	25RB#0	-46.04,-34.73	PASS
Band4	5MHz	16QAM	20375	1RB#24	-22.64,-49.99,-54.89	PASS
Band4	5MHz	16QAM	20375	25RB#0	-36.00,-46.30	PASS
Band4	10MHz	QPSK	20000	1RB#0	-50.46,-54.18,-27.55,-45.92,-48.12,-49.57,-49.91,-50.10	PASS
Band4	10MHz	QPSK	20000	50RB#0	-49.89,-42.15	PASS
Band4	10MHz	QPSK	20350	1RB#49	-28.49,-52.37,-58.92	PASS
Band4	10MHz	QPSK	20350	50RB#0	-41.76,-46.66	PASS

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

Band4	10MHz	16QAM	20000	1RB#0	-51.43,-54.65,-28.64,-49.07	PASS
Band4	10MHz	16QAM	20000	50RB#0	-49.69,-43.59	PASS
Band4	10MHz	16QAM	20350	1RB#49	-28.70,-53.79	PASS
Band4	10MHz	16QAM	20350	50RB#0	-43.57,-48.40	PASS
Band4	15MHz	QPSK	20025	1RB#0	-44.50,-47.33,-21.80	PASS
Band4	15MHz	QPSK	20025	75RB#0	-44.09,-39.82	PASS
Band4	15MHz	QPSK	20325	1RB#74	-24.14,-46.38,-48.01,-52.88	PASS
Band4	15MHz	QPSK	20325	75RB#0	-37.01,-40.09	PASS
Band4	15MHz	16QAM	20025	1RB#0	-45.38,-47.97,-24.11,-31.30	PASS
Band4	15MHz	16QAM	20025	75RB#0	-44.88,-39.84	PASS
Band4	15MHz	16QAM	20325	1RB#74	-25.19,-47.07,-48.73,-53.27	PASS
Band4	15MHz	16QAM	20325	75RB#0	-39.38,-43.04	PASS
Band4	20MHz	QPSK	20050	1RB#0	-46.05,-51.96,-26.37	PASS
Band4	20MHz	QPSK	20050	100RB#0	-47.22,-42.36	PASS
Band4	20MHz	16QAM	20050	1RB#0	-47.27,-48.80,-27.91,-32.59,-35.63,-37.22,-37.50,-38.05,-38.20,-43.91	PASS
Band4	20MHz	16QAM	20050	100RB#0	-46.82,-42.94	PASS
Band5	1.4MHz	QPSK	20407	1RB#0	-57.41,-23.43	PASS
Band5	1.4MHz	QPSK	20407	6RB#0	-46.31,-31.05	PASS
Band5	1.4MHz	QPSK	20643	1RB#5	-19.75,-54.80	PASS
Band5	1.4MHz	QPSK	20643	6RB#0	-26.76,-40.44	PASS
Band5	1.4MHz	16QAM	20407	1RB#0	-58.80,-25.05	PASS
Band5	1.4MHz	16QAM	20407	6RB#0	-46.43,-31.99	PASS
Band5	1.4MHz	16QAM	20643	1RB#5	-21.69,-55.08	PASS
Band5	1.4MHz	16QAM	20643	6RB#0	-29.26,-41.76	PASS
Band5	3MHz	QPSK	20415	1RB#0	-54.59,-22.39	PASS
Band5	3MHz	QPSK	20415	15RB#0	-41.42,-33.83	PASS
Band5	3MHz	QPSK	20635	1RB#14	-16.72,-50.77	PASS
Band5	3MHz	QPSK	20635	15RB#0	-32.02,-36.95	PASS
Band5	3MHz	16QAM	20415	1RB#0	-56.16,-23.33	PASS
Band5	3MHz	16QAM	20415	15RB#0	-43.28,-35.06	PASS
Band5	3MHz	16QAM	20635	1RB#14	-18.10,-51.35	PASS
Band5	3MHz	16QAM	20635	15RB#0	-33.12,-38.55	PASS
Band5	5MHz	QPSK	20425	1RB#0	-54.26,-19.97	PASS
Band5	5MHz	QPSK	20425	25RB#0	-40.59,-32.30	PASS
Band5	5MHz	QPSK	20625	1RB#24	-17.64,-50.03	PASS
Band5	5MHz	QPSK	20625	25RB#0	-31.55,-37.30	PASS
Band5	5MHz	16QAM	20425	1RB#0	-55.12,-20.75	PASS
Band5	5MHz	16QAM	20425	25RB#0	-42.88,-34.53	PASS
Band5	5MHz	16QAM	20625	1RB#24	-17.55,-50.41	PASS
Band5	5MHz	16QAM	20625	25RB#0	-32.64,-38.68	PASS
Band5	10MHz	QPSK	20450	1RB#0	-53.11,-23.06	PASS
Band5	10MHz	QPSK	20450	50RB#0	-40.18,-35.35	PASS

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

Band5	10MHz	16QAM	20450	1RB#0	-53.91,-24.75	PASS
Band5	10MHz	16QAM	20450	50RB#0	-42.36,-37.49	PASS
Band7	5MHz	QPSK	20775	1RB#0	-49.65,-45.23,-39.12,-18.42	PASS
Band7	5MHz	QPSK	20775	25RB#0	-40.98,-33.28,-28.09,-30.93	PASS
Band7	5MHz	QPSK	21425	1RB#24	-17.80,-38.18,-49.04,-48.68	PASS
Band7	5MHz	QPSK	21425	25RB#0	-30.91,-27.80,-38.41,-39.64	PASS
Band7	5MHz	16QAM	20775	1RB#0	-49.77,-46.01,-41.37,-18.76,-36.11,-36.32,-36.89,-37.45,-39.54,-40.04,-40.69,-41.21,-42.08,-44.05,-44.29	PASS
Band7	5MHz	16QAM	20775	25RB#0	-40.36,-34.95,-29.09,-31.54	PASS
Band7	5MHz	16QAM	21425	1RB#24	-19.20,-39.62,-49.14,-50.22	PASS
Band7	5MHz	16QAM	21425	25RB#0	-31.61,-28.49,-37.93,-39.59	PASS
Band7	10MHz	QPSK	20800	1RB#0	-50.27,-44.56,-40.43,-20.09	PASS
Band7	10MHz	QPSK	20800	50RB#0	-44.61,-33.61,-31.41,-34.17	PASS
Band7	10MHz	QPSK	21400	1RB#49	-19.89,-40.63,-46.89,-50.41	PASS
Band7	10MHz	QPSK	21400	50RB#0	-33.41,-29.88,-34.12,-43.36	PASS
Band7	10MHz	16QAM	20800	1RB#0	-50.25,-45.44,-41.11,-21.27,-32.62,-35.98	PASS
Band7	10MHz	16QAM	20800	50RB#0	-43.93,-34.69,-32.38,-35.80	PASS
Band7	10MHz	16QAM	21400	1RB#49	-21.13,-41.62,-47.63,-50.44	PASS
Band7	10MHz	16QAM	21400	50RB#0	-34.77,-31.17,-35.80,-42.69	PASS
Band7	15MHz	QPSK	20825	1RB#0	-47.83,-35.54,-38.92,-23.20,-25.88,-37.81,-38.37,-39.14,-20.57,-22.29,-22.37,-24.38,-25.92,-26.08,-27.47,-29.72,-30.31,-30.55,-31.09,-31.63,-31.69,-32.37,-35.06,-35.35,-35.76,-42.78	PASS
Band7	15MHz	QPSK	20825	75RB#0	-39.52,-34.56,-30.71,-31.78	PASS

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

Band7	15MHz	QPSK	21375	1RB#74	-21.45,-21.63,-23.30,-23.98,-34.00,-39.73,-44.85,-50.29	PASS
Band7	15MHz	QPSK	21375	75RB#0	-32.85,-29.44,-33.88,-45.27	PASS
Band7	15MHz	16QAM	20825	1RB#0	-50.01,-42.72,-40.19,-21.80,-21.98,-24.12,-25.43,-27.18,-29.41,-30.34,-31.74,-32.80,-33.00,-33.31,-37.72	PASS
Band7	15MHz	16QAM	20825	75RB#0	-41.20,-35.26,-33.23,-34.63	PASS
Band7	15MHz	16QAM	21375	1RB#74	-20.86,-21.51,-27.65,-27.95,-28.70,-31.48,-31.77,-34.88,-37.16,-39.47,-45.46,-50.33	PASS
Band7	15MHz	16QAM	21375	75RB#0	-34.90,-32.50,-36.11,-45.44	PASS
Band7	20MHz	QPSK	20850	1RB#0	-50.07,-46.81,-35.07,-22.03,-23.57,-23.93,-23.96,-25.24,-26.79,-27.42,-27.89,-28.91,-29.33,-30.43,-30.64,-30.70,-31.39,-32.94,-36.55,-36.86,-38.01,-39.35	PASS
Band7	20MHz	QPSK	20850	100RB#0	-39.88,-35.28,-32.91,-34.23	PASS
Band7	20MHz	QPSK	21350	1RB#99	-20.88,-23.41,-24.17,-25.82,-26.36,-26.95,-27.72,-30.53,-30.80,-30.97,-33.83,-36.43,-37.50,-40.64,-47.59,-50.57	PASS
Band7	20MHz	QPSK	21350	100RB#0	-33.11,-32.65,-35.87,-48.70	PASS
Band7	20MHz	16QAM	20850	1RB#0	-50.06,-47.09,-39.10,-20.34,-21.94,-23.35,-23.79,-24.15,-24.19,-24.66,-24.95,-26.02,-26.80,-28.07,-28.40,-28.53,-28.69,-28.73,-28.78,-30.06,-30.06,-30.80,-32.12,-32.38,-32.79,-33.23,-34.01,-35.66	PASS
Band7	20MHz	16QAM	20850	100RB#0	-41.17,-35.73,-33.75,-35.60	PASS
Band7	20MHz	16QAM	21350	1RB#99	-20.41,-22.39,-22.60,-24.22,-25.19,-27.31,-	PASS

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

					28.91,-30.28,-33.39,-33.75,-34.64,-35.34,-36.77,-38.17,-38.28,-42.35,-47.52,-50.50	
Band7	20MHz	16QAM	21350	100RB#0	-34.23,-33.99,-37.30,-48.50	PASS
Band12	1.4MHz	QPSK	23017	1RB#0	-28.92,-22.01	PASS
Band12	1.4MHz	QPSK	23017	6RB#0	-34.02,-30.17	PASS
Band12	1.4MHz	QPSK	23173	1RB#5	-19.41,-33.53	PASS
Band12	1.4MHz	QPSK	23173	6RB#0	-27.14,-32.41	PASS
Band12	1.4MHz	16QAM	23017	1RB#0	-30.54,-22.71	PASS
Band12	1.4MHz	16QAM	23017	6RB#0	-34.35,-31.62	PASS
Band12	1.4MHz	16QAM	23173	1RB#5	-20.78,-33.69	PASS
Band12	1.4MHz	16QAM	23173	6RB#0	-27.96,-35.06	PASS
Band12	3MHz	QPSK	23025	1RB#0	-28.72,-22.09	PASS
Band12	3MHz	QPSK	23025	15RB#0	-39.07,-34.00	PASS
Band12	3MHz	QPSK	23165	1RB#14	-21.43,-32.93	PASS
Band12	3MHz	QPSK	23165	15RB#0	-32.34,-37.62	PASS
Band12	3MHz	16QAM	23025	1RB#0	-29.86,-22.72	PASS
Band12	3MHz	16QAM	23025	15RB#0	-38.47,-35.54	PASS
Band12	3MHz	16QAM	23165	1RB#14	-23.31,-34.71	PASS
Band12	3MHz	16QAM	23165	15RB#0	-33.20,-40.18	PASS
Band12	5MHz	QPSK	23035	1RB#0	-24.64,-22.55	PASS
Band12	5MHz	QPSK	23035	25RB#0	-36.67,-35.75	PASS
Band12	5MHz	16QAM	23035	1RB#0	-25.30,-23.18	PASS
Band12	5MHz	16QAM	23035	25RB#0	-37.31,-36.28	PASS
Band12	10MHz	QPSK	23060	1RB#0	-28.99,-28.92	PASS
Band12	10MHz	QPSK	23060	50RB#0	-41.06,-43.30	PASS
Band12	10MHz	16QAM	23060	1RB#0	-29.83,-29.80	PASS
Band12	10MHz	16QAM	23060	50RB#0	-42.17,-44.68	PASS
Band13	5MHz	QPSK	23205	1RB#0	-51.55,-17.92	PASS
Band13	5MHz	QPSK	23205	25RB#0	-38.66,-30.55	PASS
Band13	5MHz	16QAM	23205	1RB#0	-52.83,-18.59	PASS
Band13	5MHz	16QAM	23205	25RB#0	-41.26,-31.27	PASS
Band25	1.4MHz	QPSK	26047	1RB#0	-52.22,-25.53	PASS
Band25	1.4MHz	QPSK	26047	6RB#0	-49.06,-33.51	PASS
Band25	1.4MHz	QPSK	26683	1RB#5	-24.61,-54.51	PASS
Band25	1.4MHz	QPSK	26683	6RB#0	-31.88,-47.63	PASS
Band25	1.4MHz	16QAM	26047	1RB#0	-53.69,-26.08	PASS
Band25	1.4MHz	16QAM	26047	6RB#0	-49.12,-33.58	PASS
Band25	1.4MHz	16QAM	26683	1RB#5	-26.66,-55.94	PASS
Band25	1.4MHz	16QAM	26683	6RB#0	-33.02,-49.21	PASS
Band25	3MHz	QPSK	26055	1RB#0	-52.14,-52.50,-23.97	PASS
Band25	3MHz	QPSK	26055	15RB#0	-46.94,-35.12	PASS
Band25	3MHz	QPSK	26675	1RB#14	-22.59,-52.89,-55.13	PASS
Band25	3MHz	QPSK	26675	15RB#0	-34.21,-40.33	PASS
Band25	3MHz	16QAM	26055	1RB#0	-53.78,-53.82,-24.66	PASS
Band25	3MHz	16QAM	26055	15RB#0	-46.80,-36.49	PASS
Band25	3MHz	16QAM	26675	1RB#14	-23.50,-54.82,-55.95	PASS

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

Band25	3MHz	16QAM	26675	15RB#0	-36.21,-42.48	PASS
Band25	5MHz	QPSK	26065	1RB#0	-49.69,-50.62,-21.54	PASS
Band25	5MHz	QPSK	26065	25RB#0	-46.29,-34.30	PASS
Band25	5MHz	QPSK	26665	1RB#24	-20.55,-52.61,-53.67	PASS
Band25	5MHz	QPSK	26665	25RB#0	-33.64,-40.14	PASS
Band25	5MHz	16QAM	26065	1RB#0	-51.20,-52.45,-21.86	PASS
Band25	5MHz	16QAM	26065	25RB#0	-46.30,-35.18	PASS
Band25	5MHz	16QAM	26665	1RB#24	-21.83,-54.99,-55.05	PASS
Band25	5MHz	16QAM	26665	25RB#0	-34.90,-42.36	PASS
Band25	10MHz	QPSK	26090	1RB#0	-49.32,-28.26,-48.02	PASS
Band25	10MHz	QPSK	26090	50RB#0	-49.10,-41.93	PASS
Band25	10MHz	QPSK	26640	1RB#49	-27.51,-53.00	PASS
Band25	10MHz	QPSK	26640	50RB#0	-40.63,-44.05	PASS
Band25	10MHz	16QAM	26090	1RB#0	-50.47,-28.92	PASS
Band25	10MHz	16QAM	26090	50RB#0	-49.29,-43.55	PASS
Band25	10MHz	16QAM	26640	1RB#49	-27.54,-54.35	PASS
Band25	10MHz	16QAM	26640	50RB#0	-42.58,-45.79	PASS
Band25	15MHz	QPSK	26115	1RB#0	-44.28,-46.61,-23.20	PASS
Band25	15MHz	QPSK	26115	75RB#0	-43.16,-38.96	PASS
Band25	15MHz	QPSK	26615	1RB#74	-22.58,-23.69,-24.34,-26.32,-26.87,-29.76,-33.39,-33.52,-39.30,-48.19,-48.47	PASS
Band25	15MHz	QPSK	26615	75RB#0	-35.28,-37.17	PASS
Band25	15MHz	16QAM	26115	1RB#0	-45.15,-47.34,-24.21	PASS
Band25	15MHz	16QAM	26115	75RB#0	-43.76,-39.16	PASS
Band25	15MHz	16QAM	26615	1RB#74	-23.33,-35.90,-46.46,-48.75,-49.02	PASS
Band25	15MHz	16QAM	26615	75RB#0	-37.55,-39.51	PASS
Band25	20MHz	QPSK	26140	1RB#0	-45.20,-51.78,-27.11	PASS
Band25	20MHz	QPSK	26140	100RB#0	-45.72,-42.10	PASS
Band25	20MHz	QPSK	26590	1RB#99	-26.95,-32.97,-33.04,-34.75,-37.17,-37.22,-38.19,-48.76,-53.74	PASS
Band25	20MHz	QPSK	26590	100RB#0	-38.79,-40.67	PASS
Band25	20MHz	16QAM	26140	1RB#0	-46.13,-27.38	PASS
Band25	20MHz	16QAM	26140	100RB#0	-46.19,-42.96	PASS
Band25	20MHz	16QAM	26590	1RB#99	-27.47,-28.97,-33.38,-33.78,-35.14,-37.33,-38.22,-39.58,-48.50	PASS
Band25	20MHz	16QAM	26590	100RB#0	-40.38,-42.45	PASS
Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dBm)	Verdict
Band26(814-824)	1.4MHz	QPSK	26697	1RB#0	-20.63,-39.10,-40.92,-41.66,-43.30,-43.55	PASS
Band26(814-824)	1.4MHz	QPSK	26697	6RB#0	-26.15,-27.06,-45.94,-46.20,-48.16,-48.33,-48.64,-50.07	PASS

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

Band26(814-824)	1.4MHz	QPSK	26783	1RB#5	-37.70,-39.54,-41.27,-41.37,-43.70,-19.45	PASS
Band26(814-824)	1.4MHz	QPSK	26783	6RB#0	-45.95,-46.34,-49.80,-50.04,-50.77,-26.61	PASS
Band26(814-824)	1.4MHz	16QAM	26697	1RB#0	-20.13,-39.71,-41.38,-42.61	PASS
Band26(814-824)	1.4MHz	16QAM	26697	6RB#0	-28.03,-29.61,-30.60,-33.31,-44.41,-47.29,-50.74,-50.93	PASS
Band26(814-824)	1.4MHz	16QAM	26783	1RB#5	-37.91,-40.04,-42.22,-42.28,-44.88,-20.37	PASS
Band26(814-824)	1.4MHz	16QAM	26783	6RB#0	-48.42,-48.90,-49.31,-51.99,-26.30	PASS
Band26(814-824)	3MHz	QPSK	26705	1RB#0	-22.02,-38.23,-39.15,-40.41,-41.89,-45.98	PASS
Band26(814-824)	3MHz	QPSK	26705	15RB#0	-30.12,-50.41,-51.30,-51.83	PASS
Band26(814-824)	3MHz	16QAM	26705	1RB#0	-24.73,-39.31,-42.41,-43.67,-46.40,-48.22	PASS
Band26(814-824)	3MHz	16QAM	26705	15RB#0	-32.60,-50.86,-52.05,-53.32,-54.27	PASS
Band26(814-824)	5MHz	QPSK	26715	1RB#0	-19.98,-39.55,-39.65,-40.38,-42.33	PASS
Band26(814-824)	5MHz	QPSK	26715	25RB#0	-32.73,-50.94,-52.49,-52.85,-52.93,-54.11,-54.28	PASS
Band26(814-824)	5MHz	QPSK	26765	1RB#24	-38.40,-39.26,-40.19,-41.58,-19.03	PASS
Band26(814-824)	5MHz	QPSK	26765	25RB#0	-51.49,-52.26,-52.61,-55.20,-29.91	PASS
Band26(814-824)	5MHz	16QAM	26715	1RB#0	-18.81,-38.75,-39.67,-41.29,-41.45	PASS
Band26(814-824)	5MHz	16QAM	26715	25RB#0	-33.91,-53.07,-53.13,-53.33,-53.35,-54.41,-54.96	PASS
Band26(814-824)	5MHz	16QAM	26765	1RB#24	-40.38,-40.66,-40.69,-41.15,-41.96,-43.27,-20.41,-49.23	PASS
Band26(814-824)	5MHz	16QAM	26765	25RB#0	-51.68,-52.41,-52.48,-53.53,-53.65,-31.25	PASS
Band26(814-824)	10MHz	QPSK	26740	1RB#0	-24.90,-55.12,-45.92,-46.57,-46.87,-46.92,-47.00,-47.13,-47.17,-47.79,-47.82,-48.61,-48.79,-76.94,-50.54,-52.04,-52.96,-53.11	PASS
Band26(814-824)	10MHz	QPSK	26740	1RB#49	-53.12,-57.65,-77.36,-42.32,-43.71,-46.35,-46.36,-46.48,-46.68,-	PASS

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

					24.79,-35.80,-45.87,-48.73,-53.78,-54.42	
Band26(814-824)	10MHz	QPSK	26740	50RB#0	-34.38,-55.15,-56.69,-57.19,-57.24,-57.49,-56.50,-57.27,-57.38,-35.86	PASS
Band26(814-824)	10MHz	16QAM	26740	1RB#0	-24.78,-56.32,-46.61,-47.13,-47.28,-77.46,-51.56,-51.59,-52.78,-53.11	PASS
Band26(814-824)	10MHz	16QAM	26740	1RB#49	-53.78,-58.17,-77.46,-42.20,-42.71,-43.67,-47.97,-48.64,-48.72,-25.15,-48.84,-55.00	PASS
Band26(814-824)	10MHz	16QAM	26740	50RB#0	-37.12,-55.46,-58.76,-59.18,-59.55,-57.07,-57.43,-58.07,-36.71	PASS
Band26(824-849)	1.4MHz	QPSK	26797	1RB#0	-57.52,-23.65	PASS
Band26(824-849)	1.4MHz	QPSK	26797	6RB#0	-46.41,-31.13	PASS
Band26(824-849)	1.4MHz	QPSK	27033	1RB#5	-19.73,-55.22	PASS
Band26(824-849)	1.4MHz	QPSK	27033	6RB#0	-26.41,-40.89	PASS
Band26(824-849)	1.4MHz	16QAM	26797	1RB#0	-58.63,-24.79	PASS
Band26(824-849)	1.4MHz	16QAM	26797	6RB#0	-46.18,-33.58	PASS
Band26(824-849)	1.4MHz	16QAM	27033	1RB#5	-21.07,-52.68	PASS
Band26(824-849)	1.4MHz	16QAM	27033	6RB#0	-28.90,-41.37	PASS
Band26(824-849)	3MHz	QPSK	26805	1RB#0	-55.95,-22.30	PASS
Band26(824-849)	3MHz	QPSK	26805	15RB#0	-41.33,-33.78	PASS
Band26(824-849)	3MHz	QPSK	27025	1RB#14	-16.33,-51.82	PASS
Band26(824-849)	3MHz	QPSK	27025	15RB#0	-31.52,-36.18	PASS
Band26(824-849)	3MHz	16QAM	26805	1RB#0	-57.29,-23.56	PASS
Band26(824-849)	3MHz	16QAM	26805	15RB#0	-43.29,-35.09	PASS
Band26(824-849)	3MHz	16QAM	27025	1RB#14	-17.21,-50.99	PASS
Band26(824-849)	3MHz	16QAM	27025	15RB#0	-33.51,-39.01	PASS

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

Band26(824-849)	5MHz	QPSK	26815	1RB#0	-54.38,-20.25	PASS
Band26(824-849)	5MHz	QPSK	26815	25RB#0	-40.89,-32.93	PASS
Band26(824-849)	5MHz	QPSK	27015	1RB#24	-17.57,-50.60	PASS
Band26(824-849)	5MHz	QPSK	27015	25RB#0	-31.26,-37.05	PASS
Band26(824-849)	5MHz	16QAM	26815	1RB#0	-55.82,-20.76	PASS
Band26(824-849)	5MHz	16QAM	26815	25RB#0	-43.21,-34.16	PASS
Band26(824-849)	5MHz	16QAM	27015	1RB#24	-18.49,-51.64	PASS
Band26(824-849)	5MHz	16QAM	27015	25RB#0	-32.19,-38.56	PASS
Band26(824-849)	10MHz	QPSK	26840	1RB#0	-52.80,-23.50	PASS
Band26(824-849)	10MHz	QPSK	26840	50RB#0	-40.22,-36.24	PASS
Band26(824-849)	10MHz	16QAM	26840	1RB#0	-53.77,-24.35	PASS
Band26(824-849)	10MHz	16QAM	26840	50RB#0	-42.07,-37.96	PASS
Band26(824-849)	15MHz	QPSK	26865	1RB#0	-46.93,-48.18,-49.93,-21.98	PASS
Band26(824-849)	15MHz	QPSK	26865	75RB#0	-35.66,-33.70	PASS
Band26(824-849)	15MHz	16QAM	26865	1RB#0	-47.70,-49.25,-22.68,-23.72,-33.00	PASS
Band26(824-849)	15MHz	16QAM	26865	75RB#0	-38.61,-35.86	PASS
Band41	5MHz	QPSK	39675	1RB#0	-46.76,-42.48,-30.75,-24.19	PASS
Band41	5MHz	QPSK	39675	25RB#0	-45.69,-41.55,-35.38,-41.31	PASS
Band41	5MHz	16QAM	39675	1RB#0	-47.40,-43.48,-32.45,-25.29	PASS
Band41	5MHz	16QAM	39675	25RB#0	-50.64,-49.97,-42.67,-47.65	PASS
Band41	10MHz	QPSK	39700	1RB#0	-47.96,-43.20,-33.17,-27.55	PASS
Band41	10MHz	QPSK	39700	50RB#0	-43.92,-38.66,-36.35,-41.45	PASS
Band41	10MHz	QPSK	41540	1RB#49	-23.57,-32.69,-42.96,-47.63	PASS
Band41	10MHz	QPSK	41540	50RB#0	-37.15,-33.54,-36.58,-42.52	PASS

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

Band41	10MHz	16QAM	39700	1RB#0	-47.70,-42.88,-32.95,-28.71	PASS
Band41	10MHz	16QAM	39700	50RB#0	-47.83,-41.96,-37.99,-42.53	PASS
Band41	10MHz	16QAM	41540	1RB#49	-23.54,-32.27,-42.70,-47.47	PASS
Band41	10MHz	16QAM	41540	50RB#0	-39.05,-36.35,-40.54,-47.55	PASS
Band41	15MHz	QPSK	39725	1RB#0	-49.22,-42.09,-33.48,-27.29	PASS
Band41	15MHz	16QAM	39725	1RB#0	-48.91,-42.26,-33.77,-34.63,-35.43,-36.94,-39.11,-28.18	PASS
Band41	20MHz	QPSK	39750	1RB#99	-50.89,-47.97,-48.30,-52.67	PASS
Band41	20MHz	QPSK	39750	100RB#0	-48.08,-41.31,-39.32,-43.72	PASS
Band41	20MHz	QPSK	41490	1RB#99	-25.50,-35.05,-43.87,-50.02	PASS
Band41	20MHz	QPSK	41490	100RB#0	-36.67,-35.45,-37.25,-45.37	PASS
Band41	20MHz	16QAM	39750	1RB#99	-50.86,-48.06,-48.12,-52.67	PASS
Band41	20MHz	16QAM	39750	100RB#0	-49.95,-42.58,-40.24,-44.15	PASS
Band41	20MHz	16QAM	41490	1RB#99	-26.09,-35.44,-44.29,-50.00	PASS
Band41	20MHz	16QAM	41490	100RB#0	-39.62,-38.62,-41.51,-49.30	PASS
Band66	1.4MHz	QPSK	131979	1RB#0	-50.73,-24.60	PASS
Band66	1.4MHz	QPSK	131979	6RB#0	-46.93,-33.36	PASS
Band66	1.4MHz	QPSK	132665	1RB#5	-26.38,-50.64	PASS
Band66	1.4MHz	QPSK	132665	6RB#0	-34.74,-49.95	PASS
Band66	1.4MHz	16QAM	131979	1RB#0	-52.11,-25.49	PASS
Band66	1.4MHz	16QAM	131979	6RB#0	-47.86,-33.52	PASS
Band66	1.4MHz	16QAM	132665	1RB#5	-27.77,-52.19	PASS
Band66	1.4MHz	16QAM	132665	6RB#0	-35.19,-50.13	PASS
Band66	3MHz	QPSK	131987	1RB#0	-51.03,-53.64,-23.11	PASS
Band66	3MHz	QPSK	131987	15RB#0	-47.57,-35.09	PASS
Band66	3MHz	QPSK	132657	1RB#14	-24.46,-51.88,-55.40	PASS
Band66	3MHz	QPSK	132657	15RB#0	-37.38,-50.10	PASS
Band66	3MHz	16QAM	131987	1RB#0	-52.71,-55.06,-23.81	PASS
Band66	3MHz	16QAM	131987	15RB#0	-46.53,-36.36	PASS
Band66	3MHz	16QAM	132657	1RB#14	-24.96,-53.48,-56.25	PASS
Band66	3MHz	16QAM	132657	15RB#0	-38.61,-49.27	PASS
Band66	5MHz	QPSK	131997	1RB#0	-49.05,-50.80,-21.10	PASS
Band66	5MHz	QPSK	131997	25RB#0	-46.74,-34.48	PASS
Band66	5MHz	QPSK	132647	1RB#24	-22.25,-42.25,-43.13,-51.53,-54.21	PASS

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

Band66	5MHz	QPSK	132647	25RB#0	-36.20,-48.46	PASS
Band66	5MHz	16QAM	131997	1RB#0	-50.90,-52.24,-21.18	PASS
Band66	5MHz	16QAM	131997	25RB#0	-46.24,-35.22	PASS
Band66	5MHz	16QAM	132647	1RB#24	-23.36,-53.14,-55.39	PASS
Band66	5MHz	16QAM	132647	25RB#0	-36.43,-47.86	PASS
Band66	10MHz	QPSK	132022	1RB#0	-50.67,-27.70	PASS
Band66	10MHz	QPSK	132022	50RB#0	-50.03,-42.09	PASS
Band66	10MHz	QPSK	132622	1RB#49	-28.41,-47.85,-48.22,-48.88,-49.29,-49.53,-49.90,-50.43,-52.68	PASS
Band66	10MHz	QPSK	132622	50RB#0	-42.98,-50.26	PASS
Band66	10MHz	16QAM	132022	1RB#0	-51.81,-28.55,-46.70,-48.51,-50.23,-50.66	PASS
Band66	10MHz	16QAM	132022	50RB#0	-49.52,-43.24	PASS
Band66	10MHz	16QAM	132622	1RB#49	-28.55,-54.03	PASS
Band66	10MHz	16QAM	132622	50RB#0	-43.82,-49.87	PASS
Band66	15MHz	QPSK	132047	1RB#0	-45.68,-47.22,-22.69	PASS
Band66	15MHz	QPSK	132047	75RB#0	-44.13,-39.52	PASS
Band66	15MHz	QPSK	132597	1RB#74	-23.70,-27.64,-46.86,-48.90	PASS
Band66	15MHz	QPSK	132597	75RB#0	-38.68,-43.96	PASS
Band66	15MHz	16QAM	132047	1RB#0	-46.68,-47.84,-23.48	PASS
Band66	15MHz	16QAM	132047	75RB#0	-44.39,-39.33	PASS
Band66	15MHz	16QAM	132597	1RB#74	-25.65,-47.91,-49.53,-50.84	PASS
Band66	15MHz	16QAM	132597	75RB#0	-40.33,-43.79	PASS
Band66	20MHz	QPSK	132072	1RB#0	-47.06,-48.15,-27.06,-27.91,-33.93,-34.14,-35.78,-36.95,-37.10,-37.81,-44.21,-44.96	PASS
Band66	20MHz	QPSK	132072	100RB#0	-47.00,-42.46	PASS
Band66	20MHz	QPSK	132572	1RB#99	-27.83,-37.37,-47.57,-53.33	PASS
Band66	20MHz	QPSK	132572	100RB#0	-42.02,-46.47	PASS
Band66	20MHz	16QAM	132072	1RB#0	-48.09,-52.50,-26.92	PASS
Band66	20MHz	16QAM	132072	100RB#0	-46.33,-42.76	PASS
Band66	20MHz	16QAM	132572	1RB#99	-28.47,-30.51,-48.82	PASS
Band66	20MHz	16QAM	132572	100RB#0	-42.90,-46.54	PASS
Band71	5MHz	QPSK	133147	1RB#0	-17.93	PASS
Band71	5MHz	QPSK	133147	1RB#24	-45.64	PASS
Band71	5MHz	QPSK	133147	25RB#0	-27.85	PASS
Band71	5MHz	QPSK	133447	1RB#0	-46.69	PASS
Band71	5MHz	QPSK	133447	1RB#24	-20.82	PASS
Band71	5MHz	QPSK	133447	25RB#0	-32.20	PASS
Band71	5MHz	16QAM	133147	1RB#0	-19.29	PASS
Band71	5MHz	16QAM	133147	1RB#24	-46.39	PASS
Band71	5MHz	16QAM	133147	25RB#0	-30.26	PASS
Band71	5MHz	16QAM	133447	1RB#0	-47.20	PASS
Band71	5MHz	16QAM	133447	1RB#24	-20.41	PASS

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

Band71	5MHz	16QAM	133447	25RB#0	-30.85	PASS
Band71	10MHz	QPSK	133172	1RB#0	-24.42	PASS
Band71	10MHz	QPSK	133172	1RB#49	-48.50	PASS
Band71	10MHz	QPSK	133172	50RB#0	-31.69	PASS
Band71	10MHz	QPSK	133422	1RB#0	-47.98	PASS
Band71	10MHz	QPSK	133422	1RB#49	-25.29	PASS
Band71	10MHz	QPSK	133422	50RB#0	-30.55	PASS
Band71	10MHz	16QAM	133172	1RB#0	-25.35	PASS
Band71	10MHz	16QAM	133172	1RB#49	-48.73	PASS
Band71	10MHz	16QAM	133172	50RB#0	-34.40	PASS
Band71	10MHz	16QAM	133422	1RB#0	-48.68	PASS
Band71	10MHz	16QAM	133422	1RB#49	-25.72	PASS
Band71	10MHz	16QAM	133422	50RB#0	-33.11	PASS
Band71	15MHz	QPSK	133197	1RB#0	-26.41	PASS
Band71	15MHz	QPSK	133197	1RB#74	-46.54	PASS
Band71	15MHz	QPSK	133197	75RB#0	-33.57	PASS
Band71	15MHz	QPSK	133397	1RB#0	-46.11	PASS
Band71	15MHz	QPSK	133397	1RB#74	-28.41	PASS
Band71	15MHz	QPSK	133397	75RB#0	-32.62	PASS
Band71	15MHz	16QAM	133197	1RB#0	-27.08	PASS
Band71	15MHz	16QAM	133197	1RB#74	-47.21	PASS
Band71	15MHz	16QAM	133197	75RB#0	-35.07	PASS
Band71	15MHz	16QAM	133397	1RB#0	-45.33	PASS
Band71	15MHz	16QAM	133397	1RB#74	-28.44	PASS
Band71	15MHz	16QAM	133397	75RB#0	-36.01	PASS
Band71	20MHz	QPSK	133222	1RB#0	-26.18	PASS
Band71	20MHz	QPSK	133222	1RB#99	-46.17	PASS
Band71	20MHz	QPSK	133222	100RB#0	-34.64	PASS
Band71	20MHz	QPSK	133372	1RB#0	-45.28	PASS
Band71	20MHz	QPSK	133372	1RB#99	-28.03	PASS
Band71	20MHz	QPSK	133372	100RB#0	-36.45	PASS
Band71	20MHz	16QAM	133222	1RB#0	-26.55	PASS
Band71	20MHz	16QAM	133222	1RB#99	-45.88	PASS
Band71	20MHz	16QAM	133222	100RB#0	-36.38	PASS
Band71	20MHz	16QAM	133372	1RB#0	-45.74	PASS
Band71	20MHz	16QAM	133372	1RB#99	-28.31	PASS
Band71	20MHz	16QAM	133372	100RB#0	-36.98	PASS

8.4.2. Test Graphs

Band2-1.4MHz-QPSK-18607-1RB#0	Band2-1.4MHz-QPSK-18607-6RB#0

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

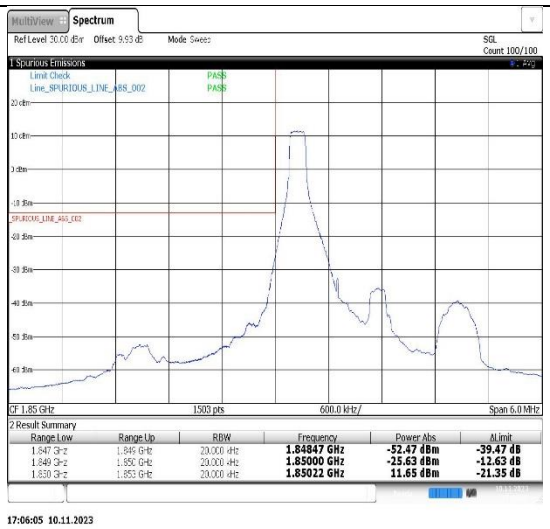

Band2-1.4MHz-QPSK-19193-1RB#5

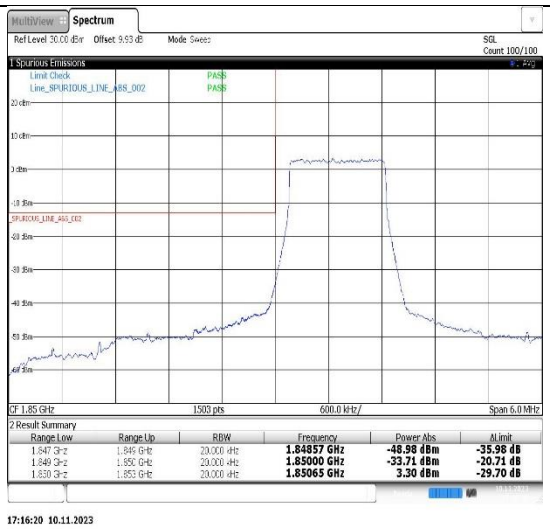

Band2-1.4MHz-QPSK-19193-6RB#0

Band2-1.4MHz-16QAM-18607-1RB#0

Band2-1.4MHz-16QAM-18607-6RB#0

Band2-1.4MHz-16QAM-19193-1RB#5

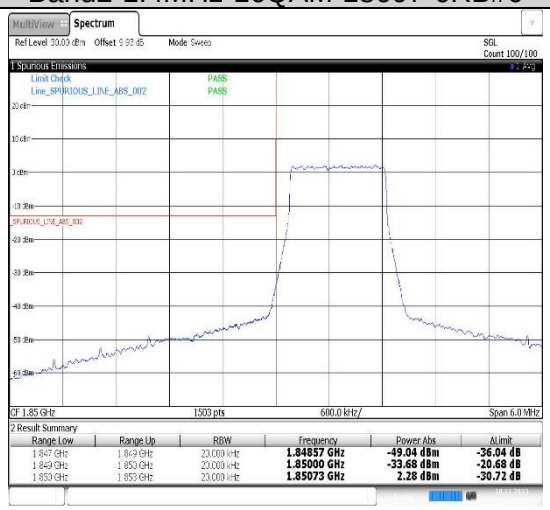

Band2-1.4MHz-16QAM-19193-6RB#0

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

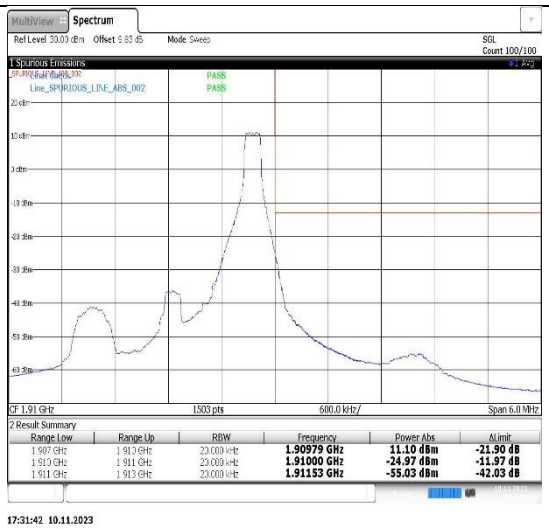

Band2-3MHz-QPSK-18615-1RB#0

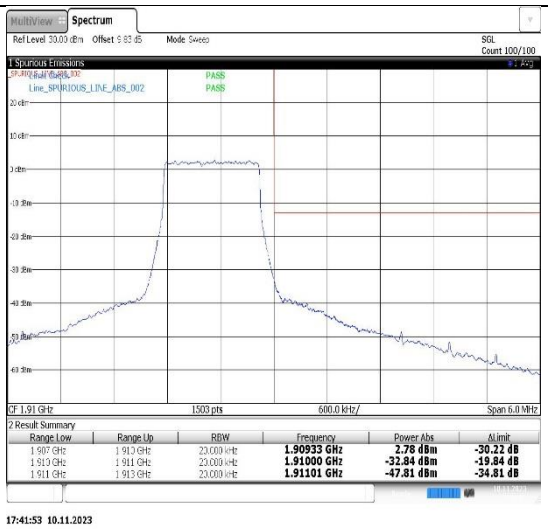

Band2-3MHz-QPSK-18615-15RB#0

Band2-3MHz-QPSK-19185-1RB#14

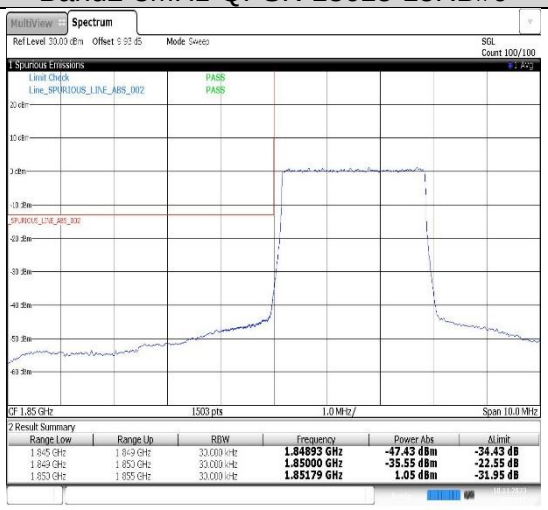

Band2-3MHz-QPSK-19185-15RB#0

Band2-3MHz-16QAM-18615-1RB#0

Band2-3MHz-16QAM-18615-15RB#0

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

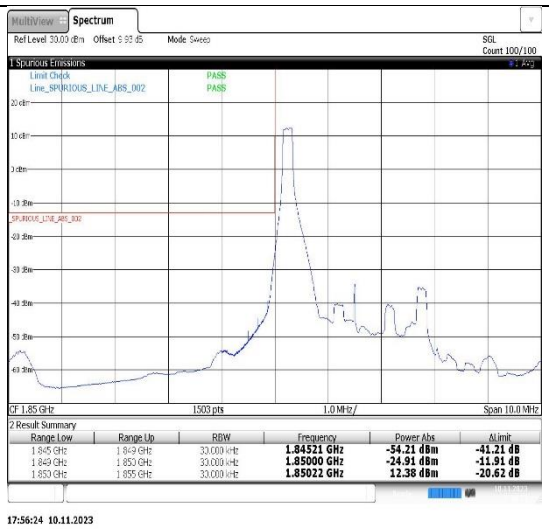

Band2-3MHz-16QAM-19185-1RB#14

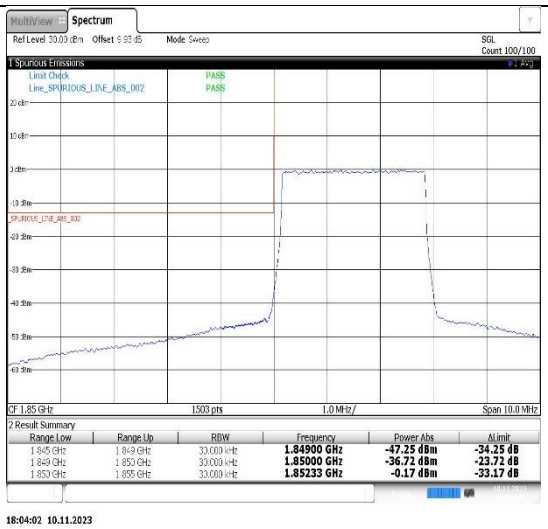

Band2-3MHz-16QAM-19185-15RB#0

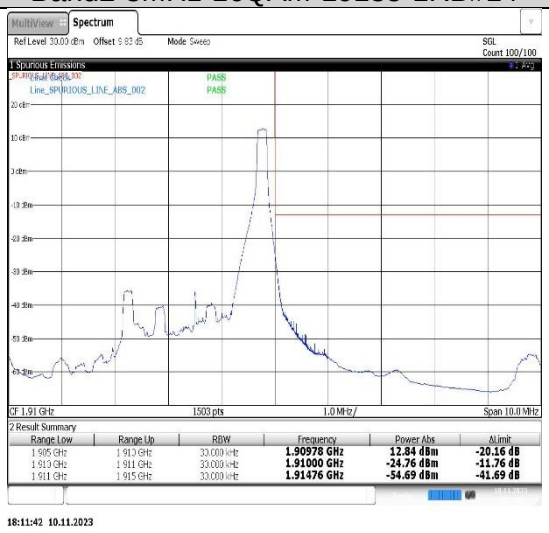

Band2-5MHz-QPSK-18625-1RB#0

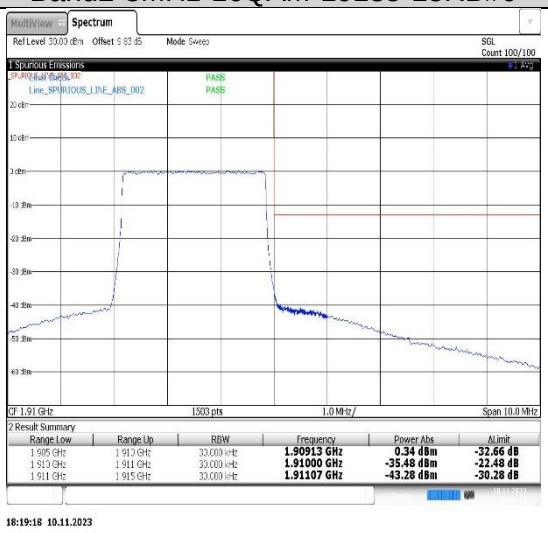

Band2-5MHz-QPSK-18625-25RB#0

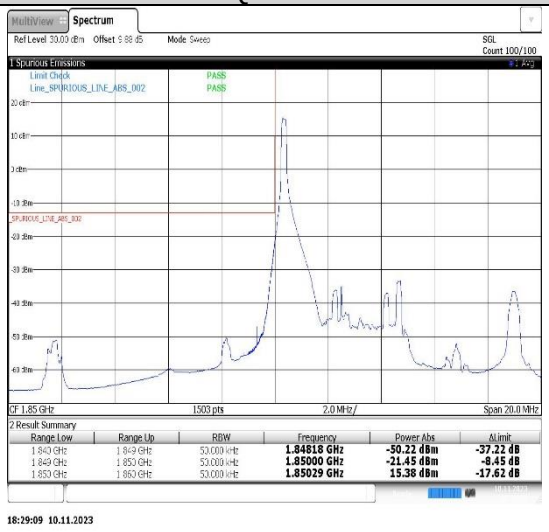

Band2-5MHz-QPSK-19175-1RB#24

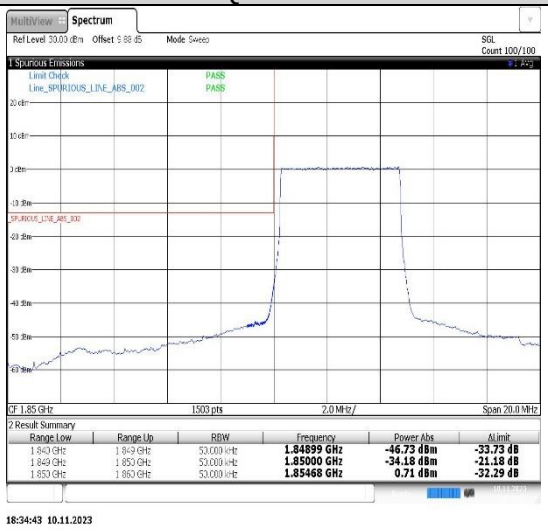

Band2-5MHz-QPSK-19175-25RB#0

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

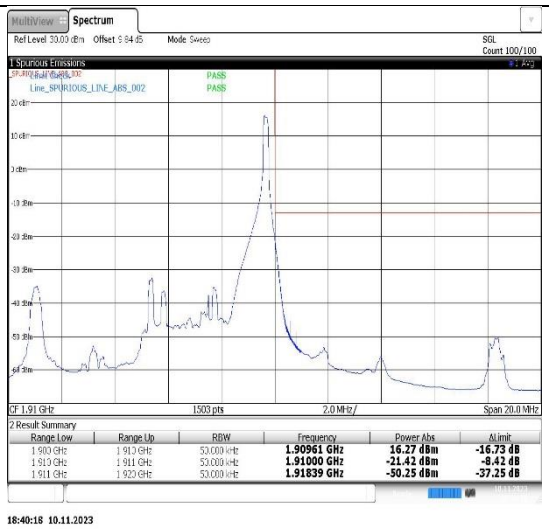

Band2-5MHz-16QAM-18625-1RB#0

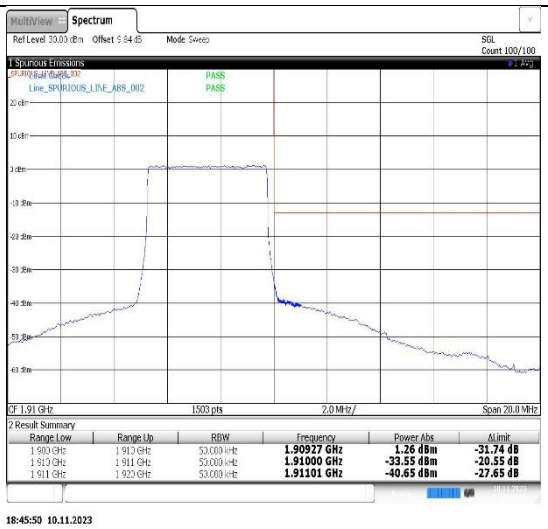

Band2-5MHz-16QAM-18625-25RB#0

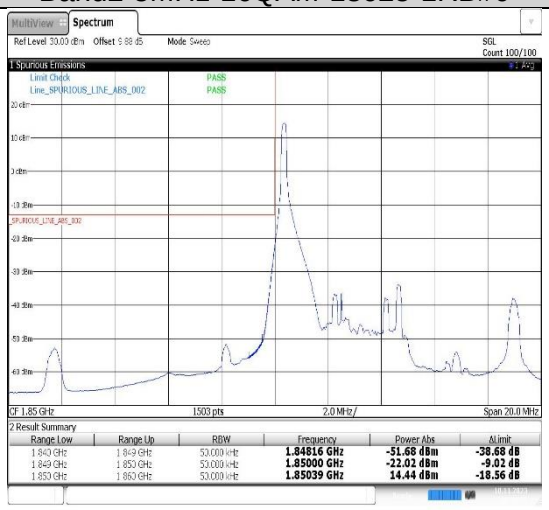

Band2-5MHz-16QAM-19175-1RB#24

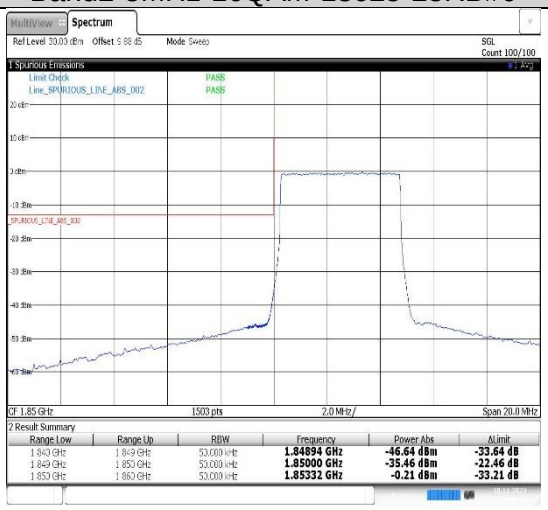

Band2-5MHz-16QAM-19175-25RB#0

Band2-10MHz-QPSK-18650-1RB#0

Band2-10MHz-QPSK-18650-50RB#0

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

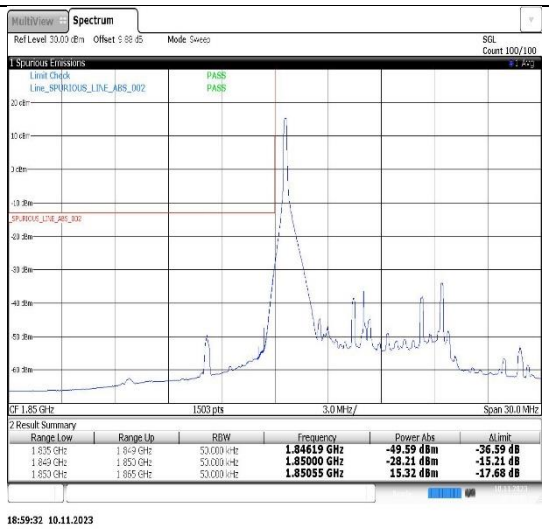

Band2-10MHz-QPSK-19150-1RB#49

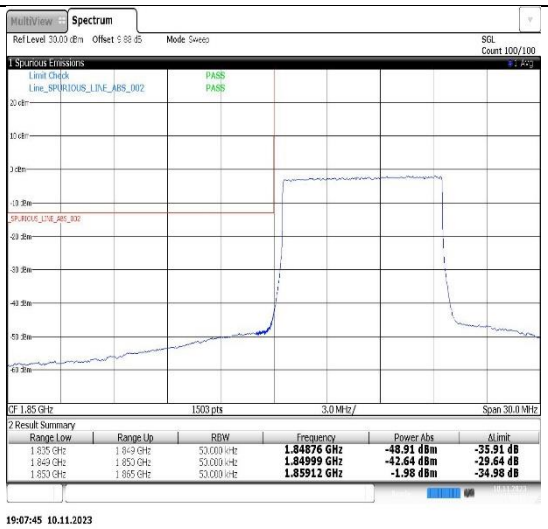

Band2-10MHz-QPSK-19150-50RB#0

Band2-10MHz-16QAM-18650-1RB#0

Band2-10MHz-16QAM-18650-50RB#0

Band2-10MHz-16QAM-19150-1RB#49

Band2-10MHz-16QAM-19150-50RB#0

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

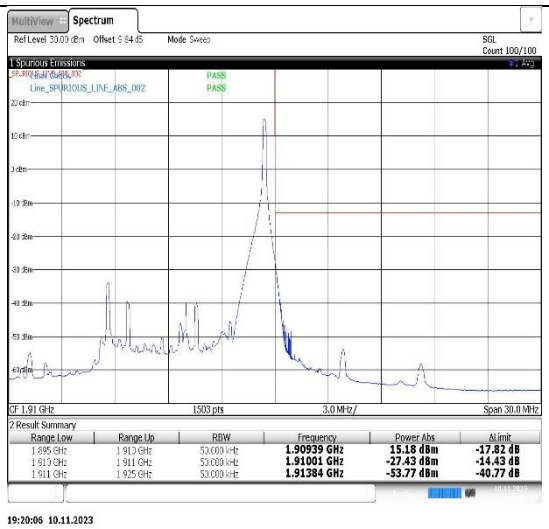

Band2-15MHz-QPSK-18675-1RB#0

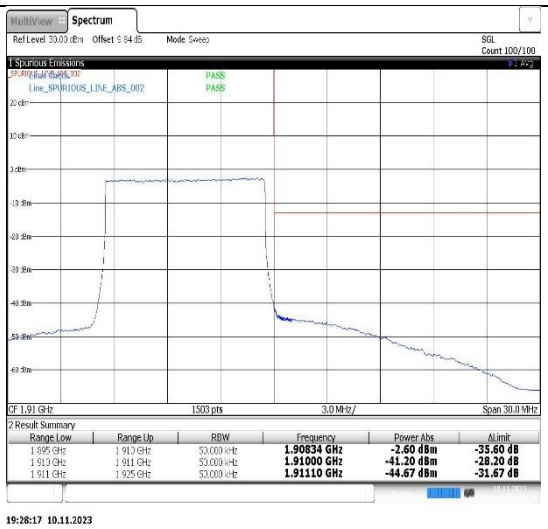

Band2-15MHz-QPSK-18675-75RB#0

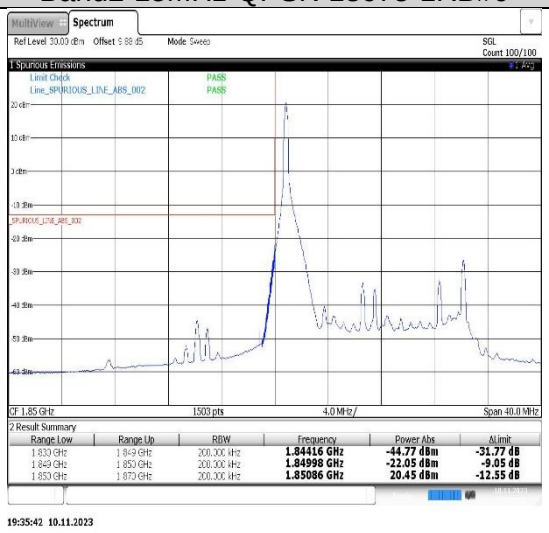

Band2-15MHz-QPSK-19125-1RB#74

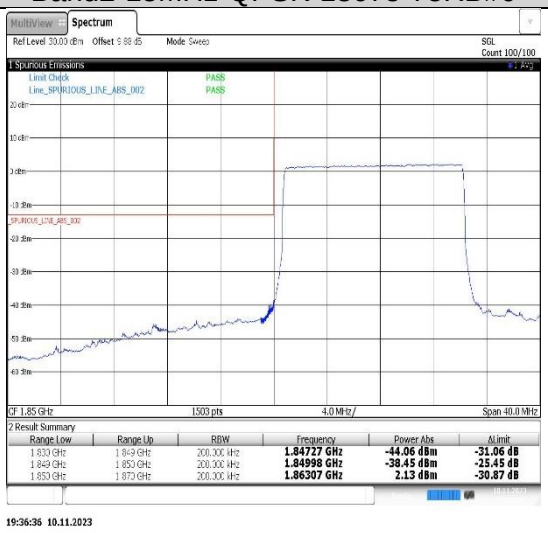

Band2-15MHz-QPSK-19125-75RB#0

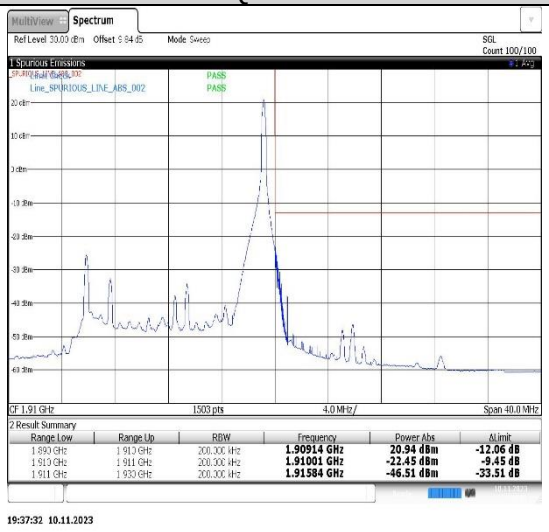

Band2-15MHz-16QAM-18675-1RB#0

Band2-15MHz-16QAM-18675-75RB#0

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

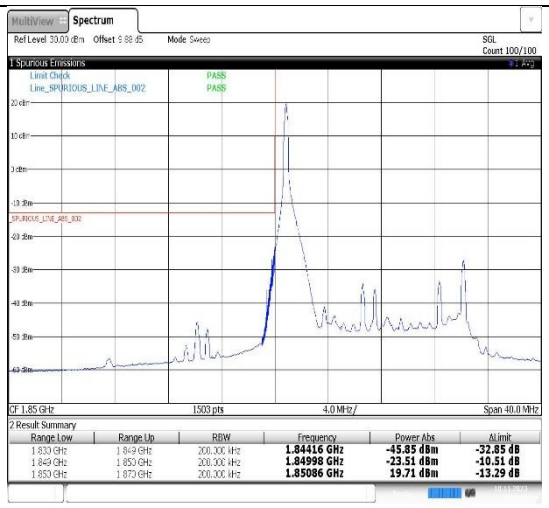

Band2-15MHz-16QAM-19125-1RB#74

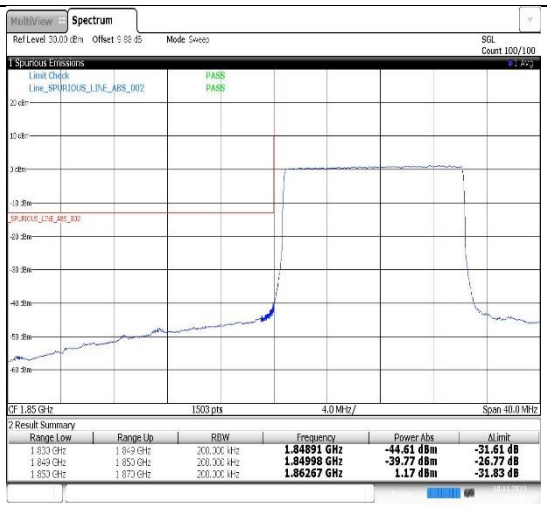

Band2-15MHz-16QAM-19125-75RB#0

Band2-20MHz-QPSK-18700-1RB#0

Band2-20MHz-QPSK-18700-100RB#0

Band2-20MHz-QPSK-19100-1RB#99

Band2-20MHz-QPSK-19100-100RB#0

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

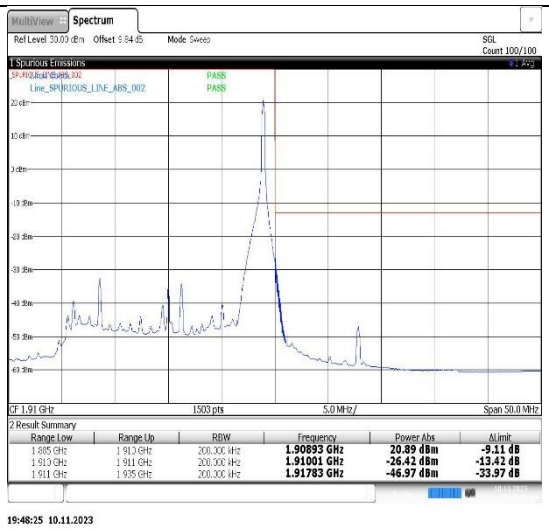

Band2-20MHz-16QAM-18700-1RB#0

Band2-20MHz-16QAM-18700-100RB#0

Band2-20MHz-16QAM-19100-1RB#99

Band2-20MHz-16QAM-19100-100RB#0

Band4-1.4MHz-QPSK-19957-1RB#0

Band4-1.4MHz-QPSK-19957-6RB#0

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

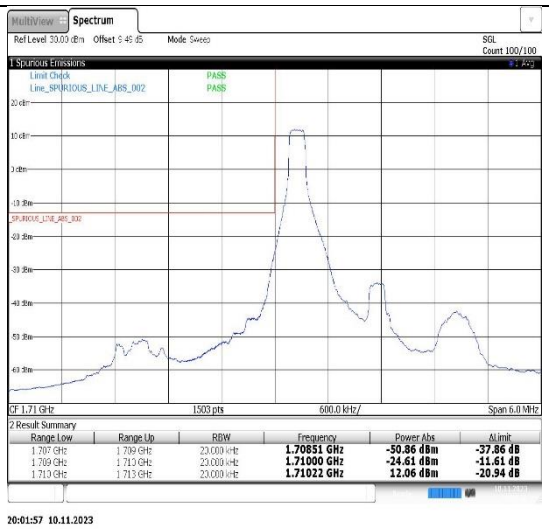

Band4-1.4MHz-QPSK-20393-1RB#5

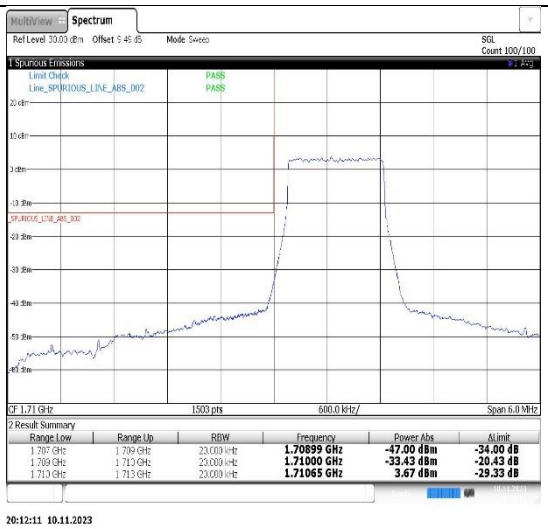

Band4-1.4MHz-QPSK-20393-6RB#0

Band4-1.4MHz-16QAM-19957-1RB#0

Band4-1.4MHz-16QAM-19957-6RB#0

Band4-1.4MHz-16QAM-20393-1RB#5

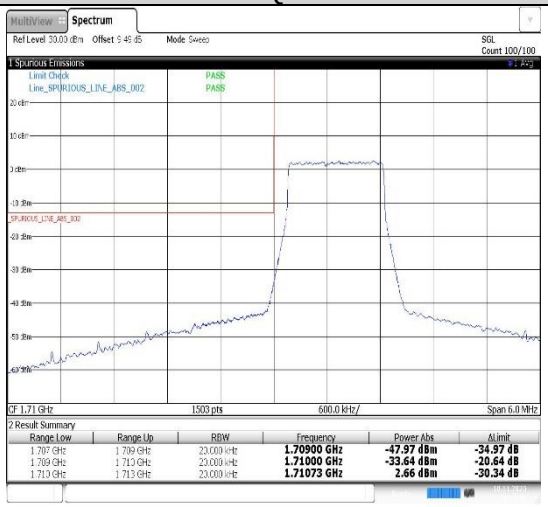

Band4-1.4MHz-16QAM-20393-6RB#0

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

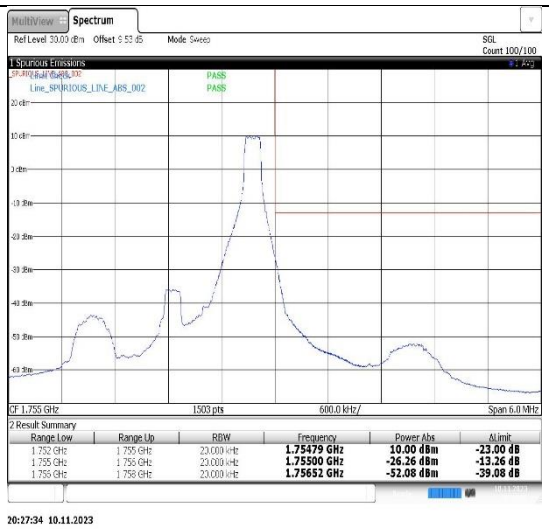

Band4-3MHz-QPSK-19965-1RB#0

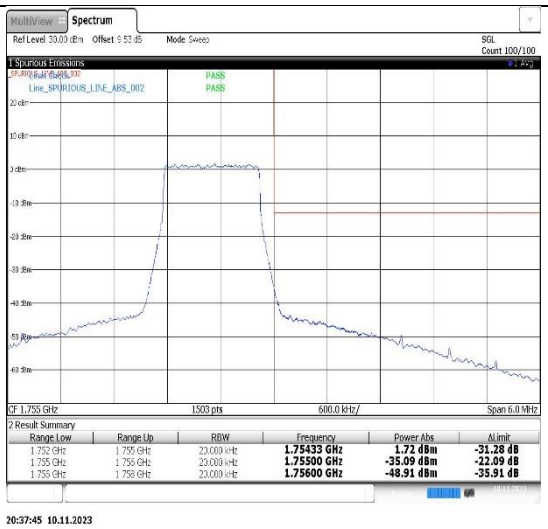

Band4-3MHz-QPSK-19965-15RB#0

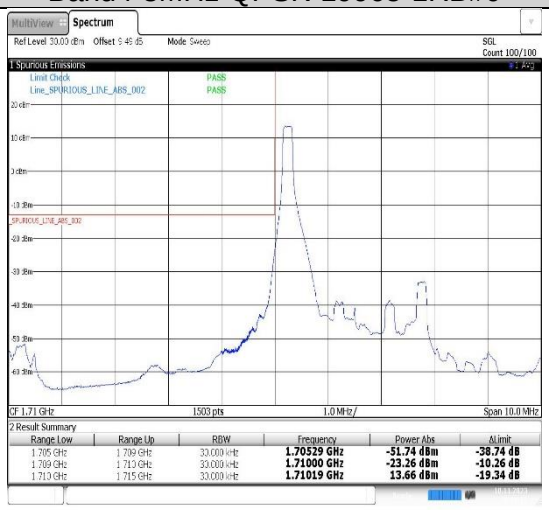

Band4-3MHz-QPSK-20385-1RB#14

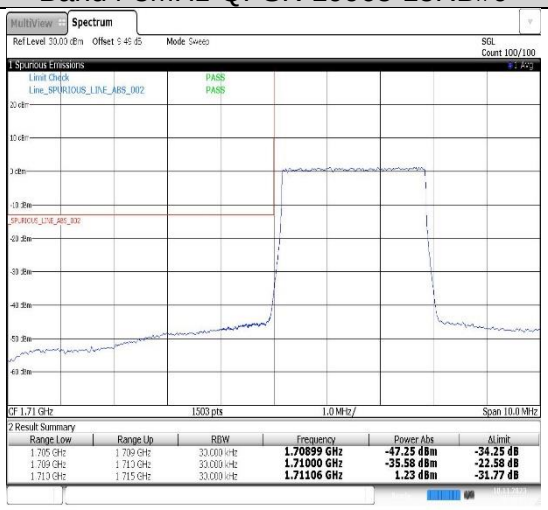

Band4-3MHz-QPSK-20385-15RB#0

Band4-3MHz-16QAM-19965-1RB#0

Band4-3MHz-16QAM-19965-15RB#0

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

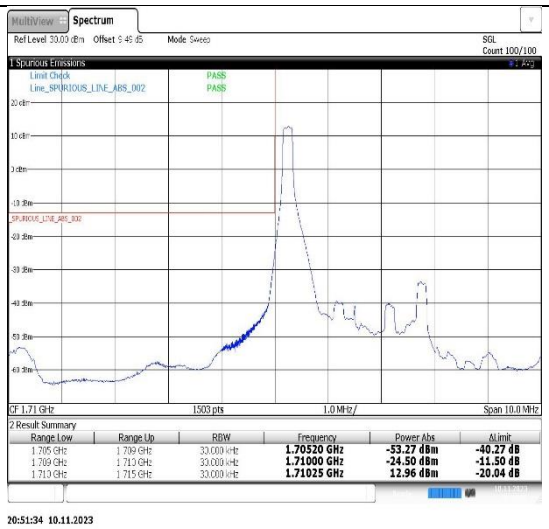

Band4-3MHz-16QAM-20385-1RB#14

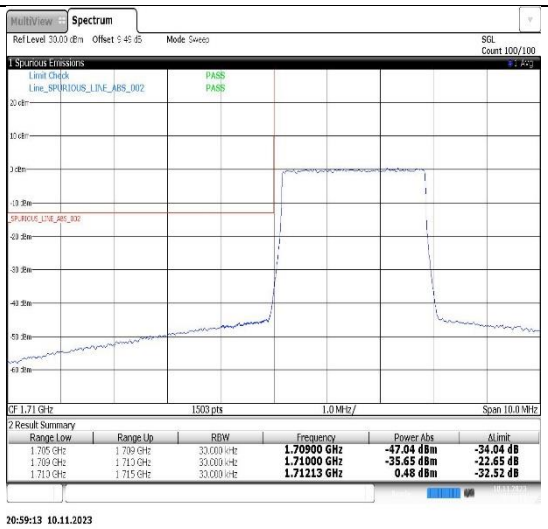

Band4-3MHz-16QAM-20385-15RB#0

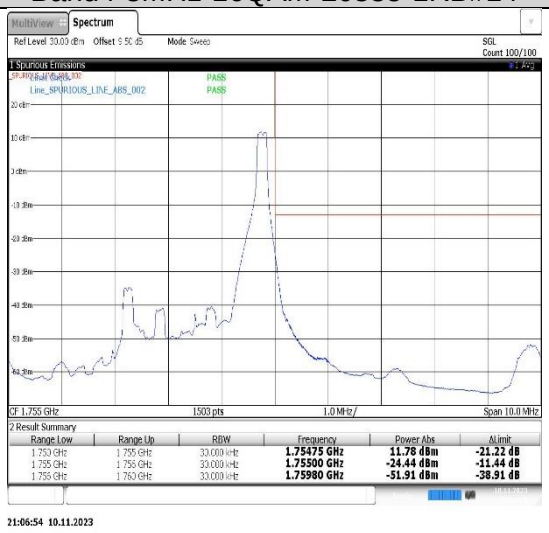

Band4-5MHz-QPSK-19975-1RB#0

Band4-5MHz-QPSK-19975-25RB#0

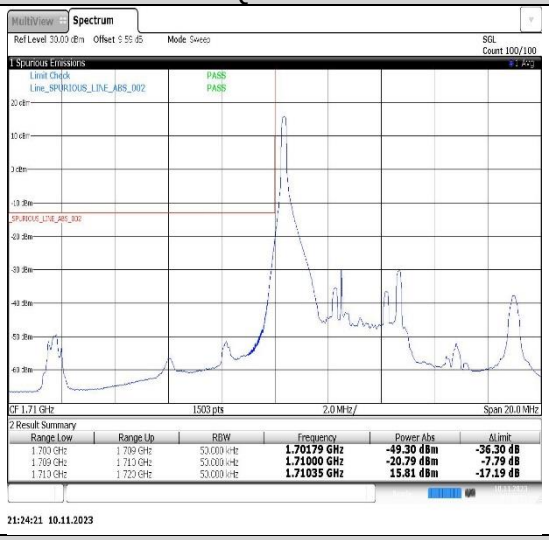

Band4-5MHz-QPSK-20375-1RB#24

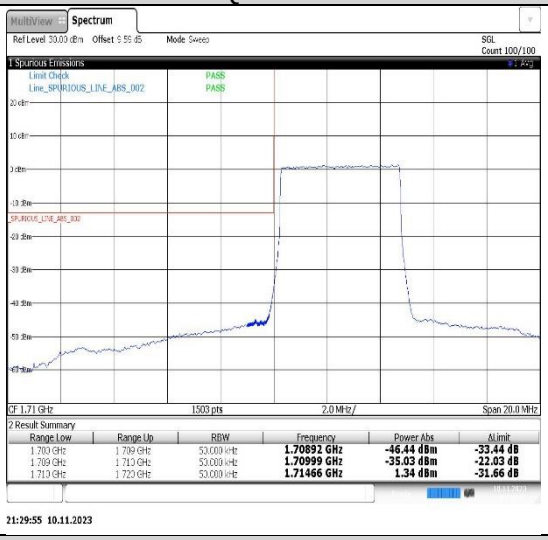

Band4-5MHz-QPSK-20375-25RB#0

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch

Band4-5MHz-16QAM-19975-1RB#0

Band4-5MHz-16QAM-19975-25RB#0

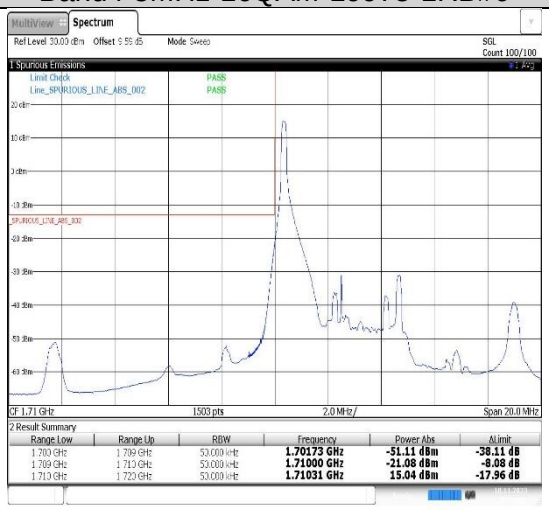

Band4-5MHz-16QAM-20375-1RB#24

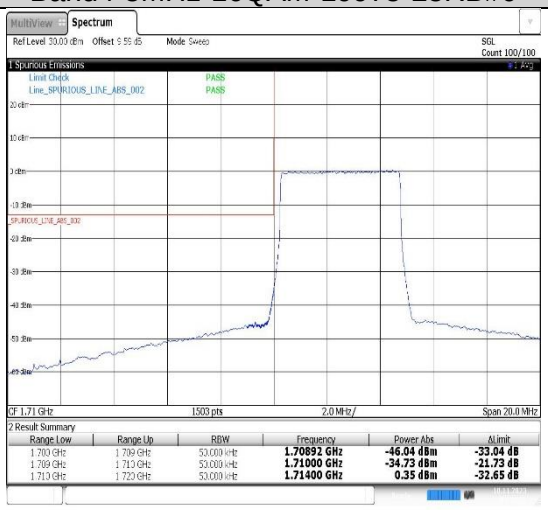

Band4-5MHz-16QAM-20375-25RB#0

Band4-10MHz-QPSK-20000-1RB#0

Band4-10MHz-QPSK-20000-50RB#0

This report shall not be reproduced except in full, without the written approval of UL Verification Services (Guangzhou) Co., Ltd, Song Shan Lake Branch