






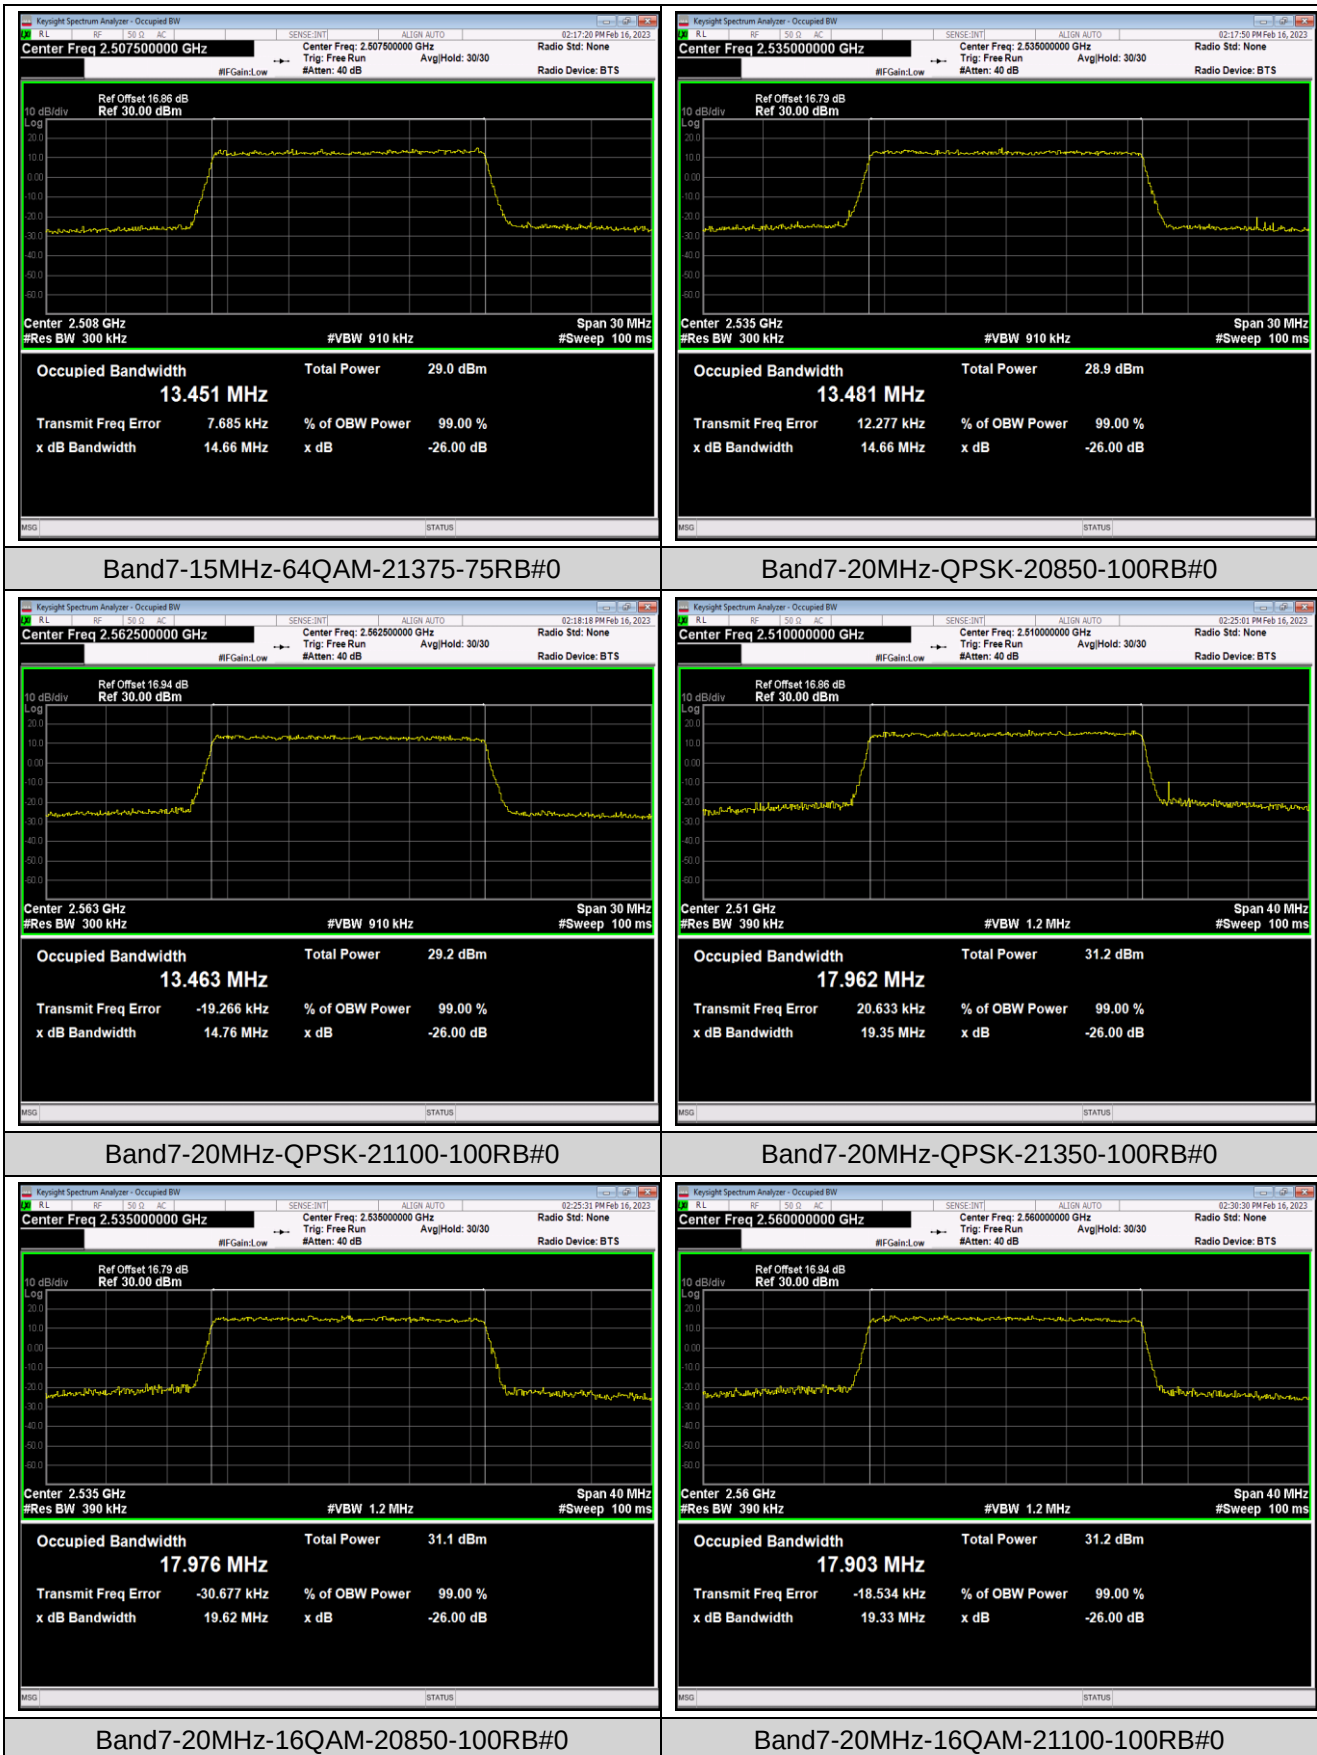


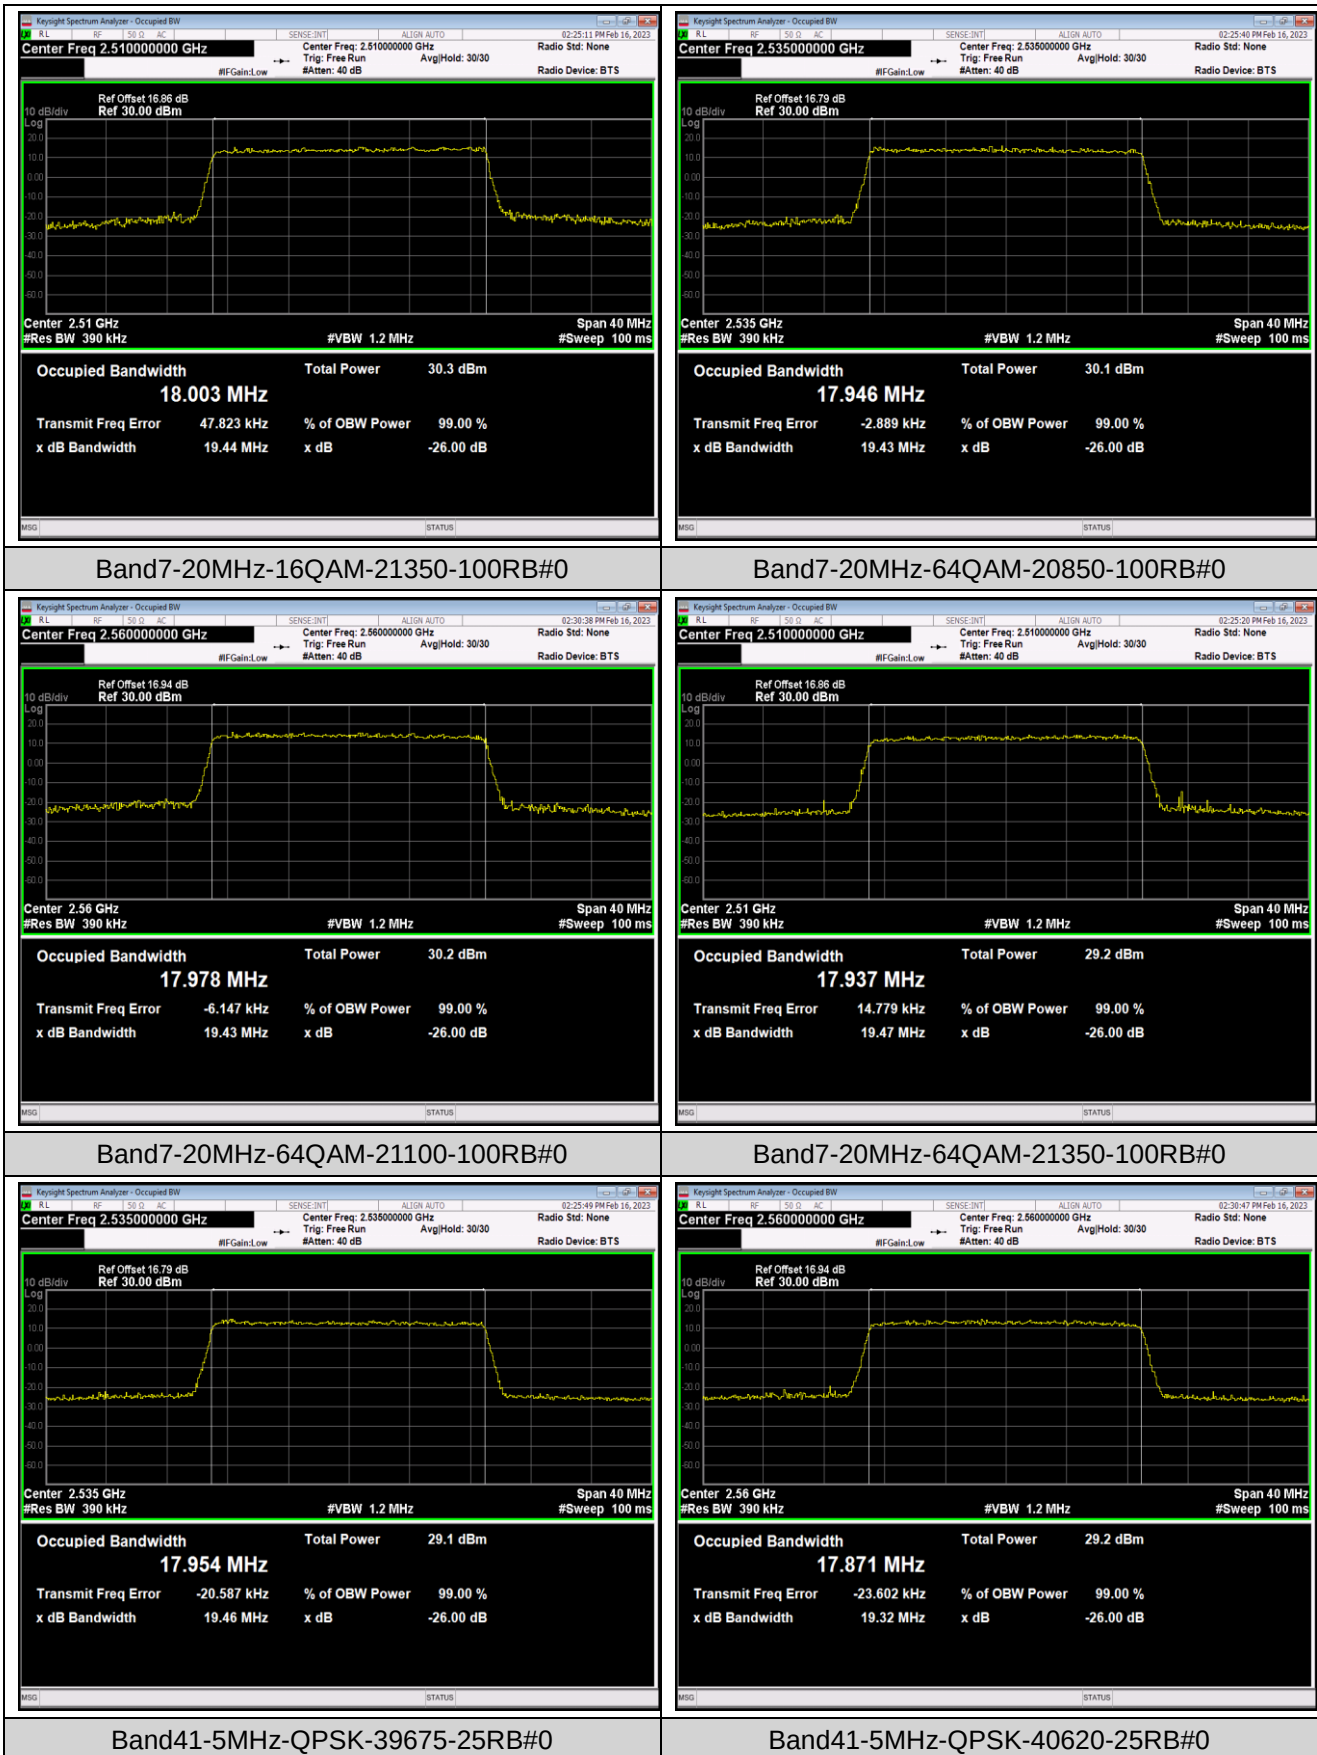


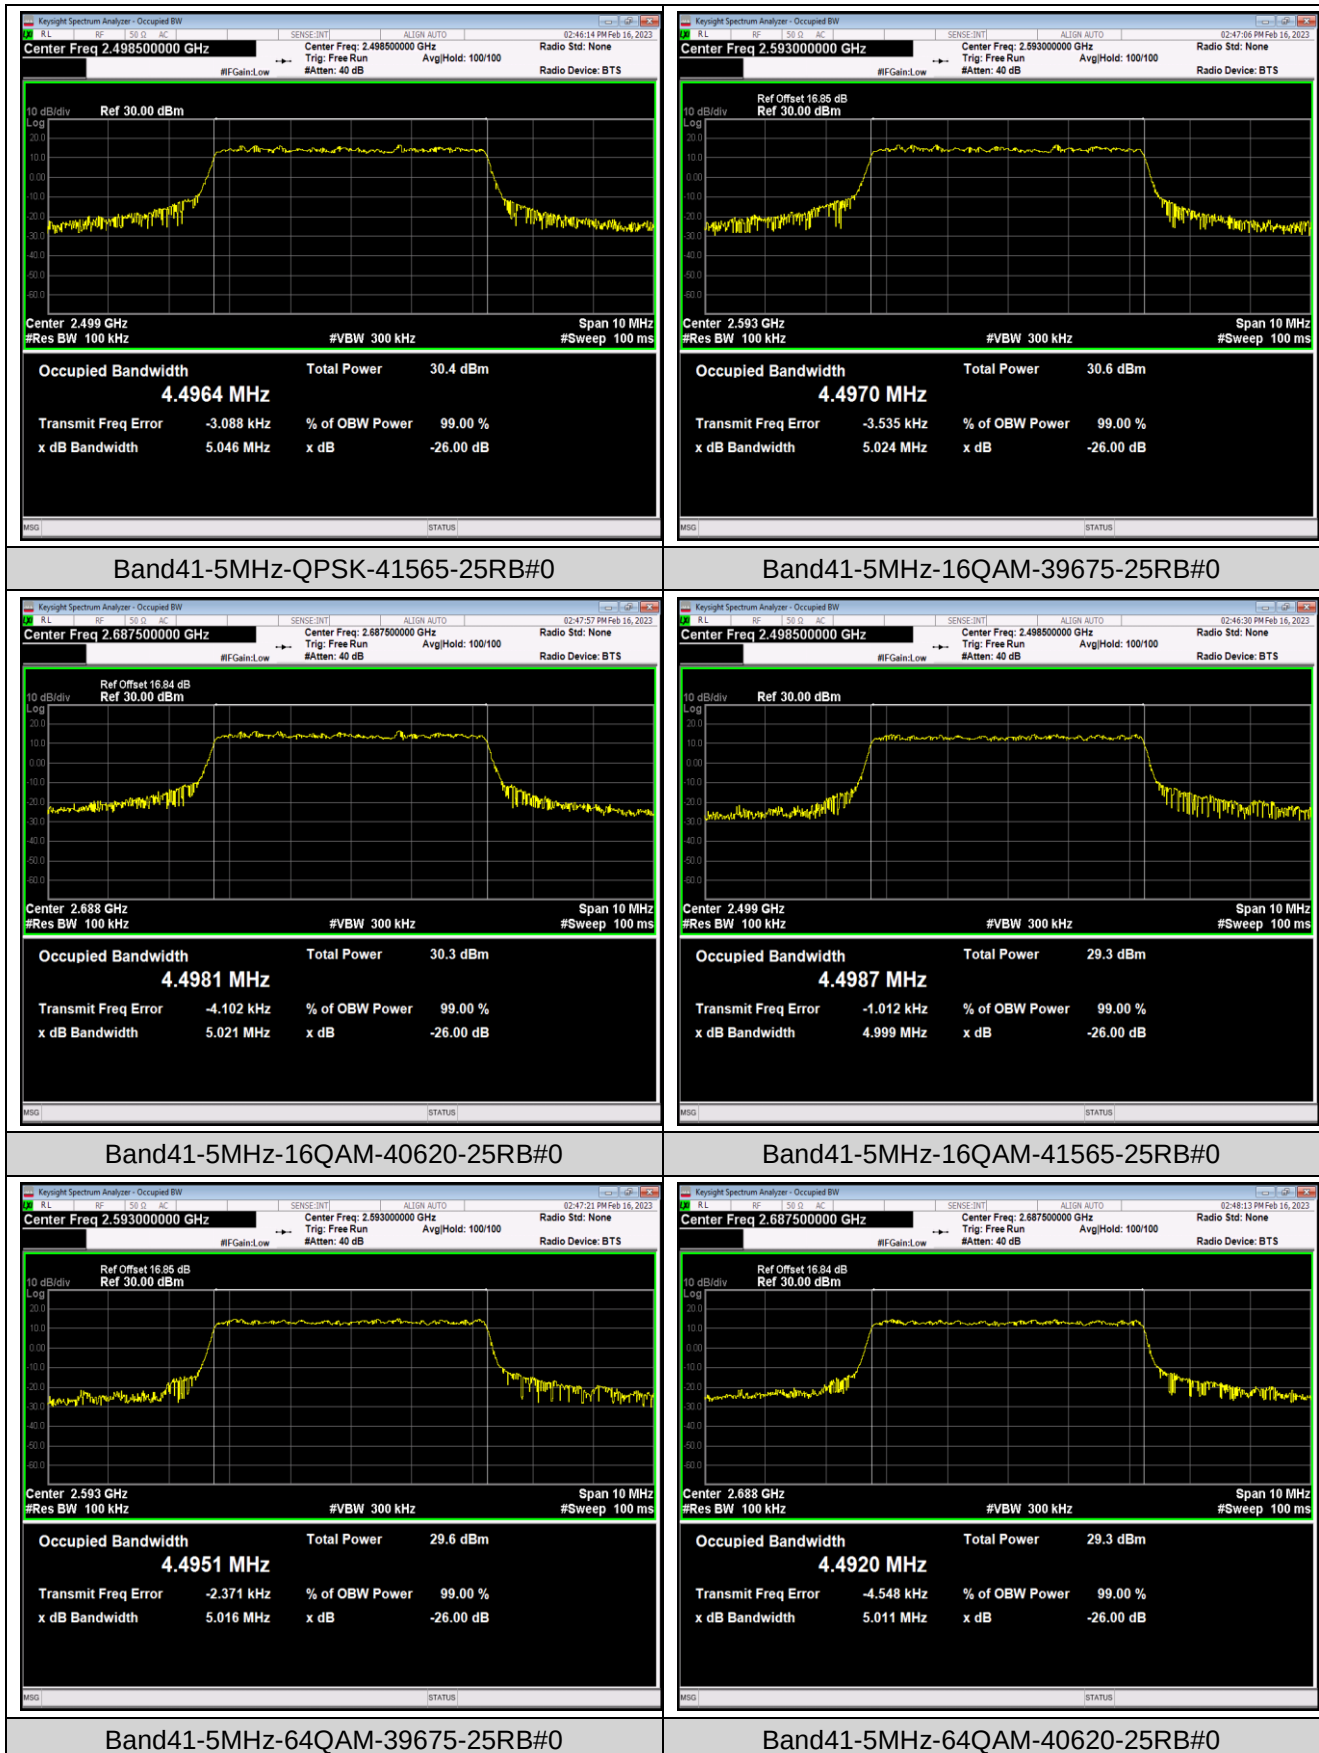

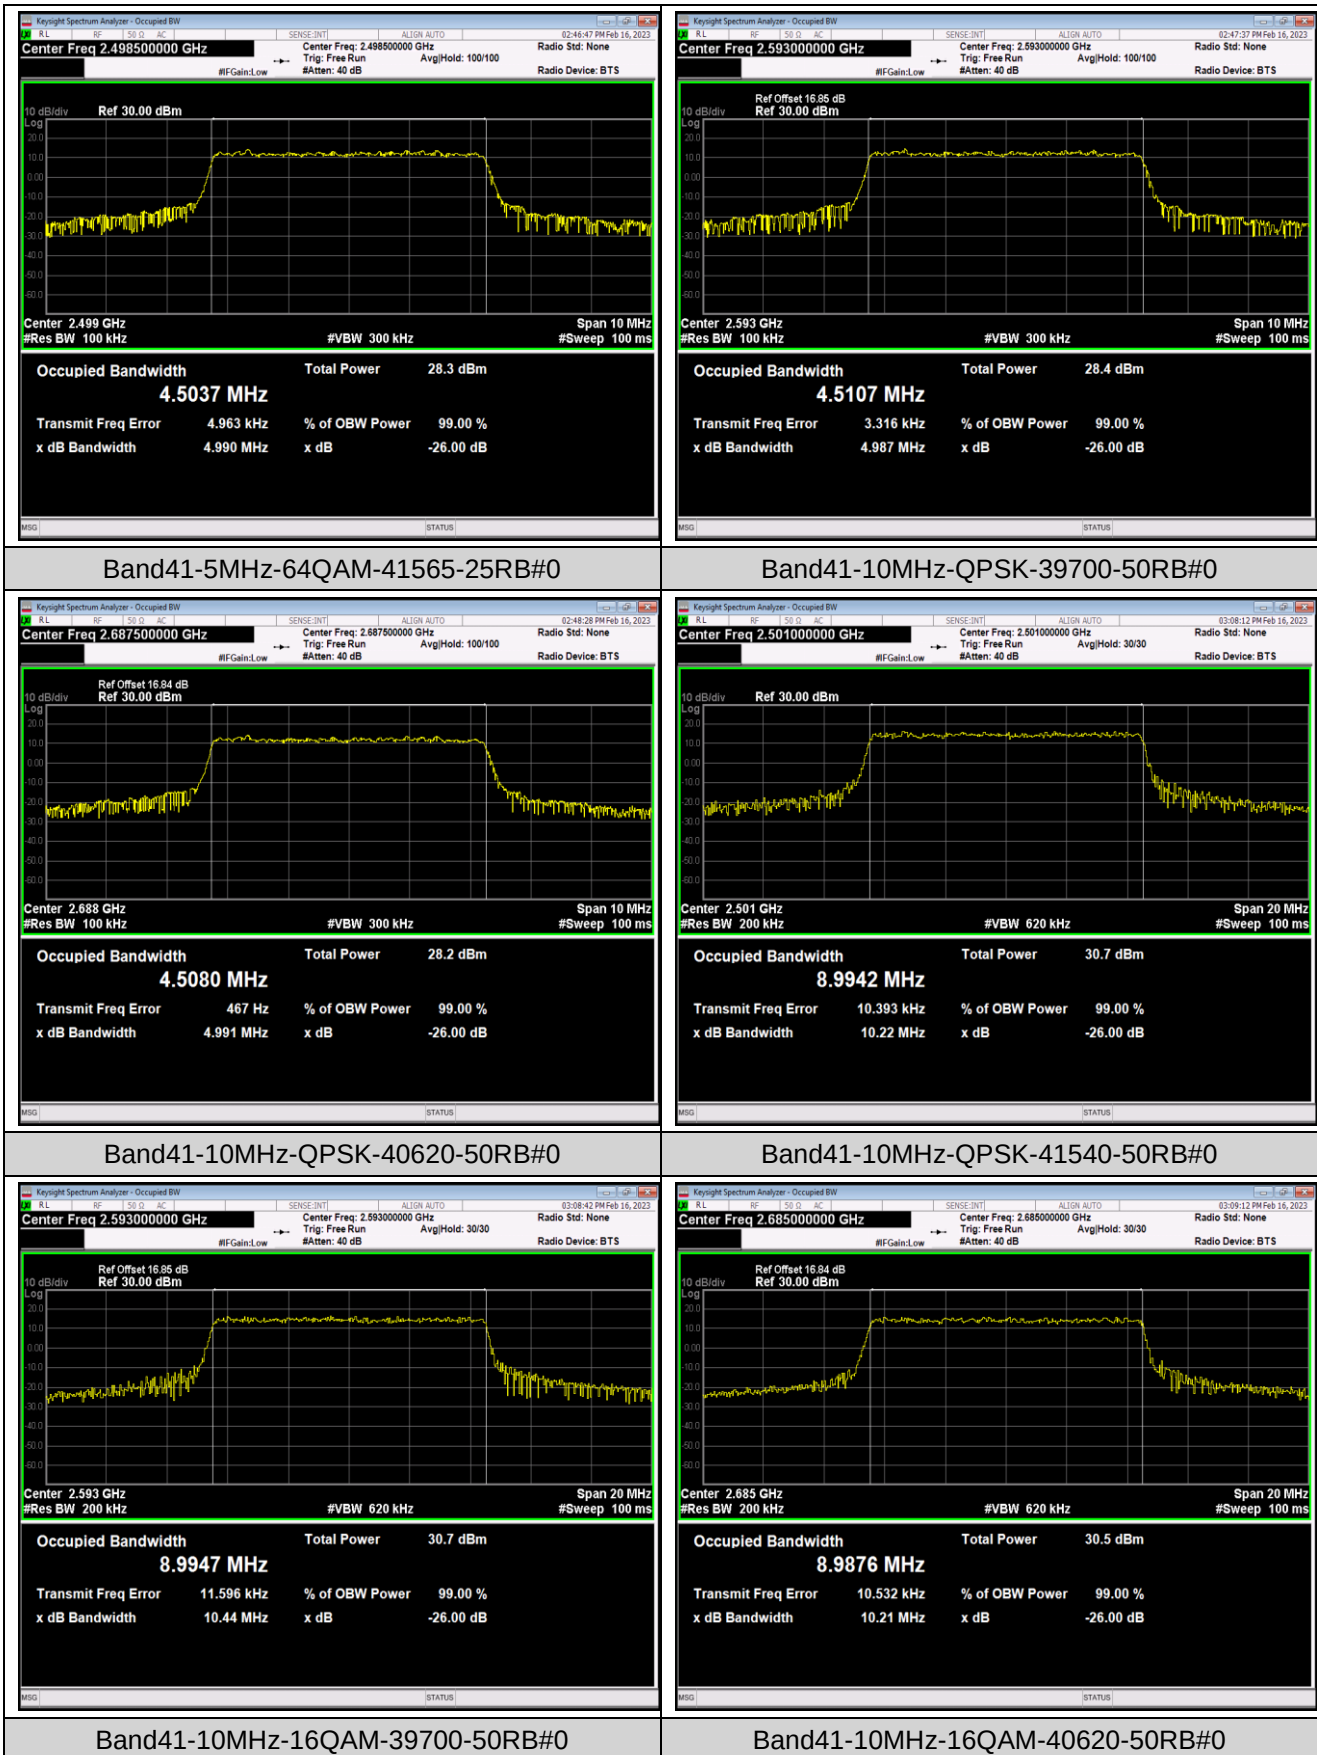

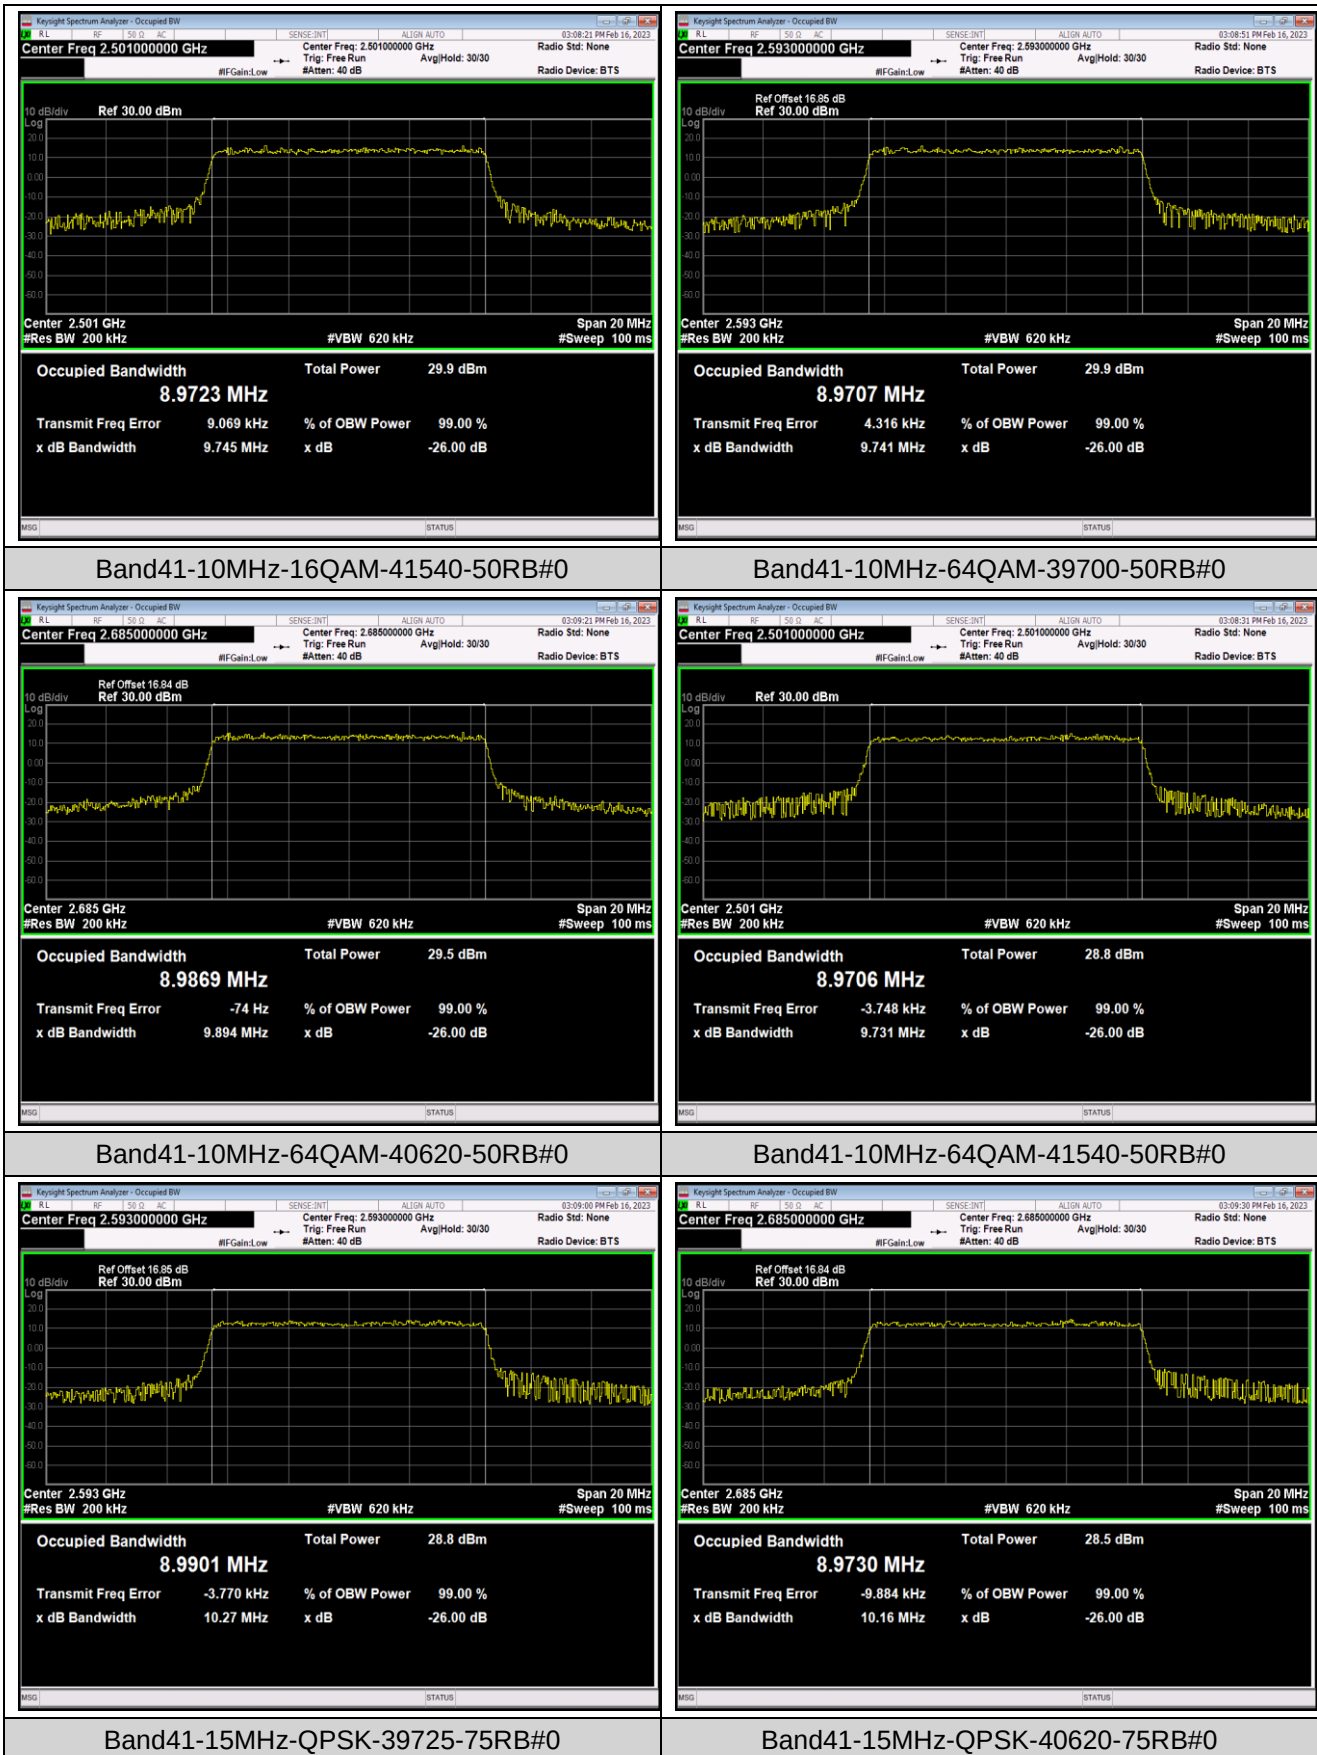

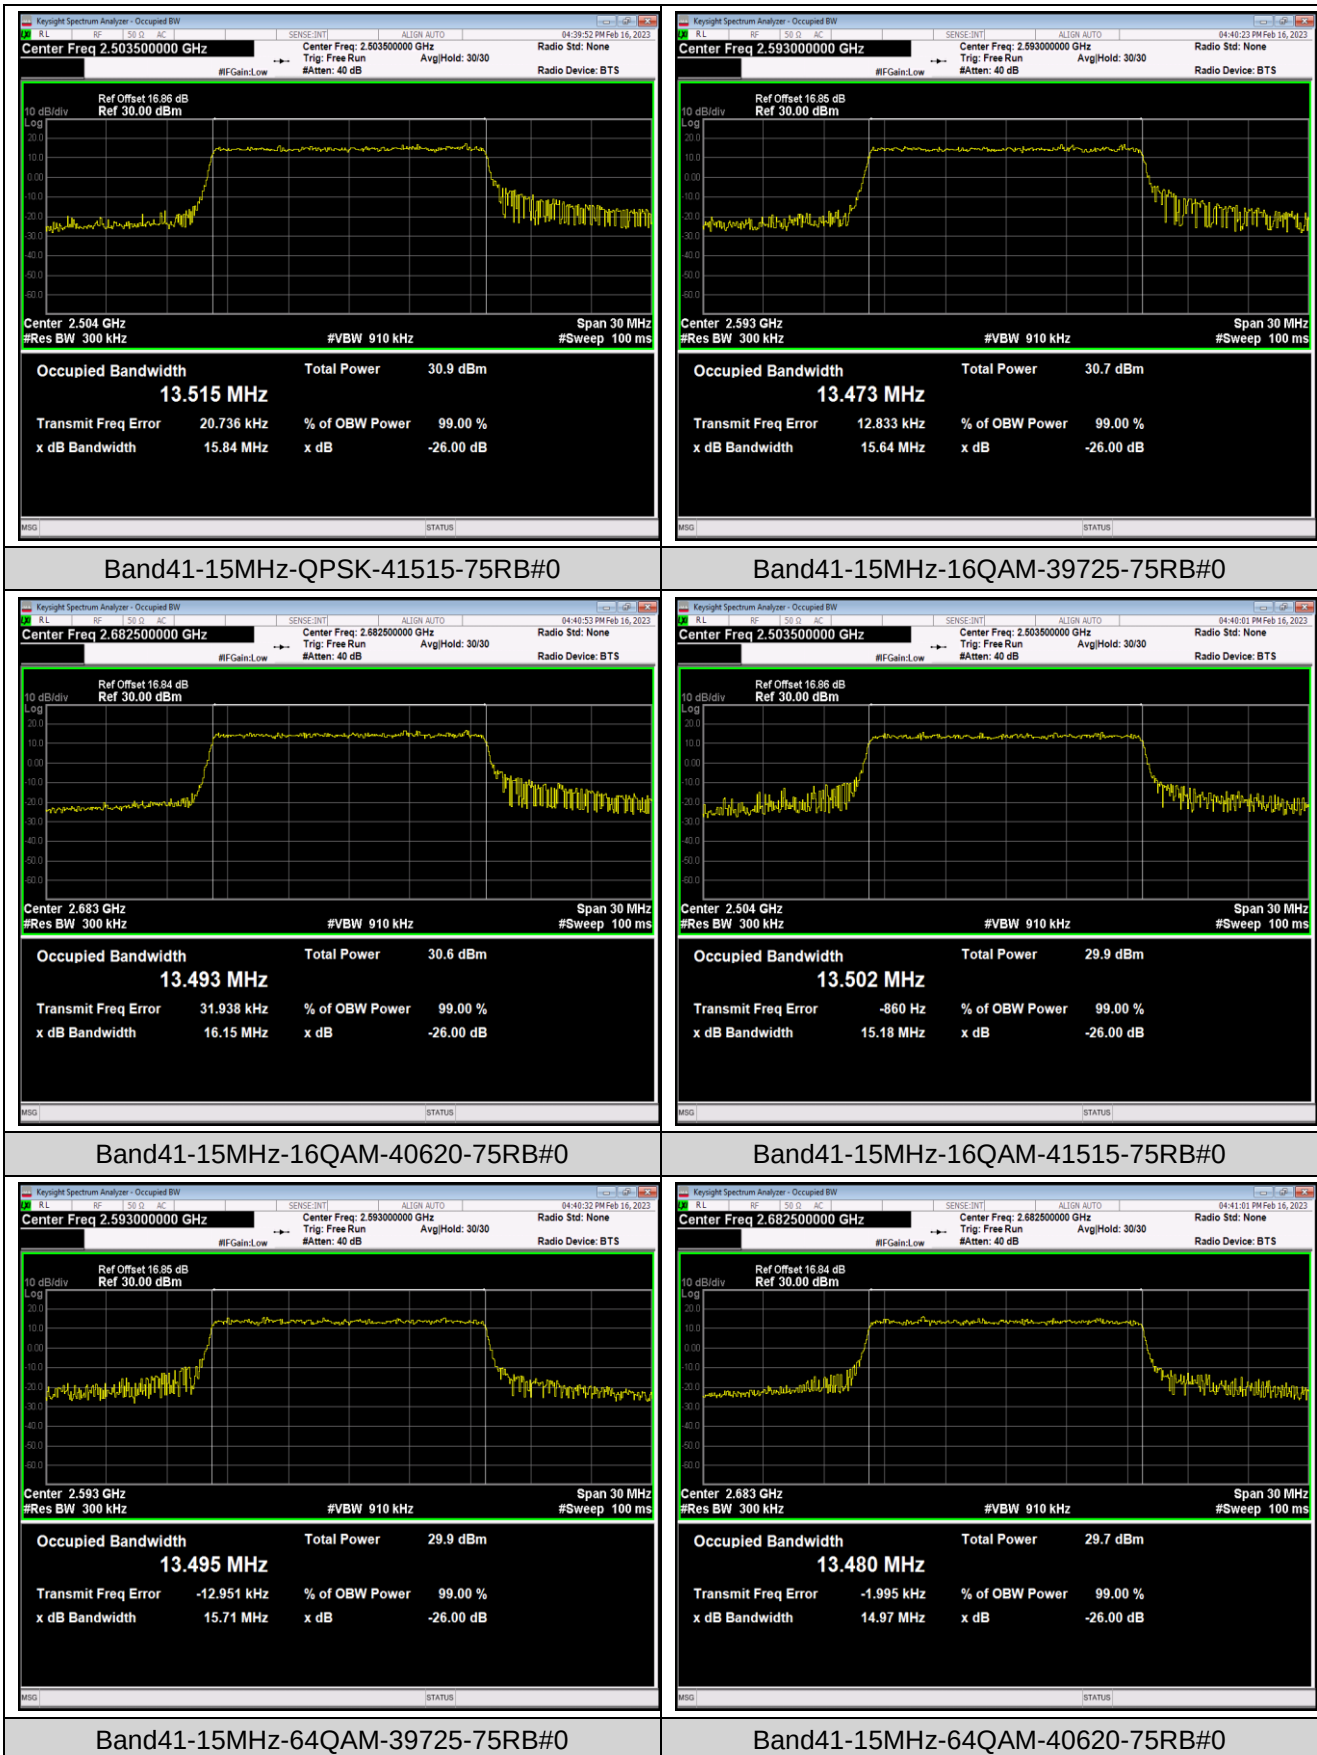

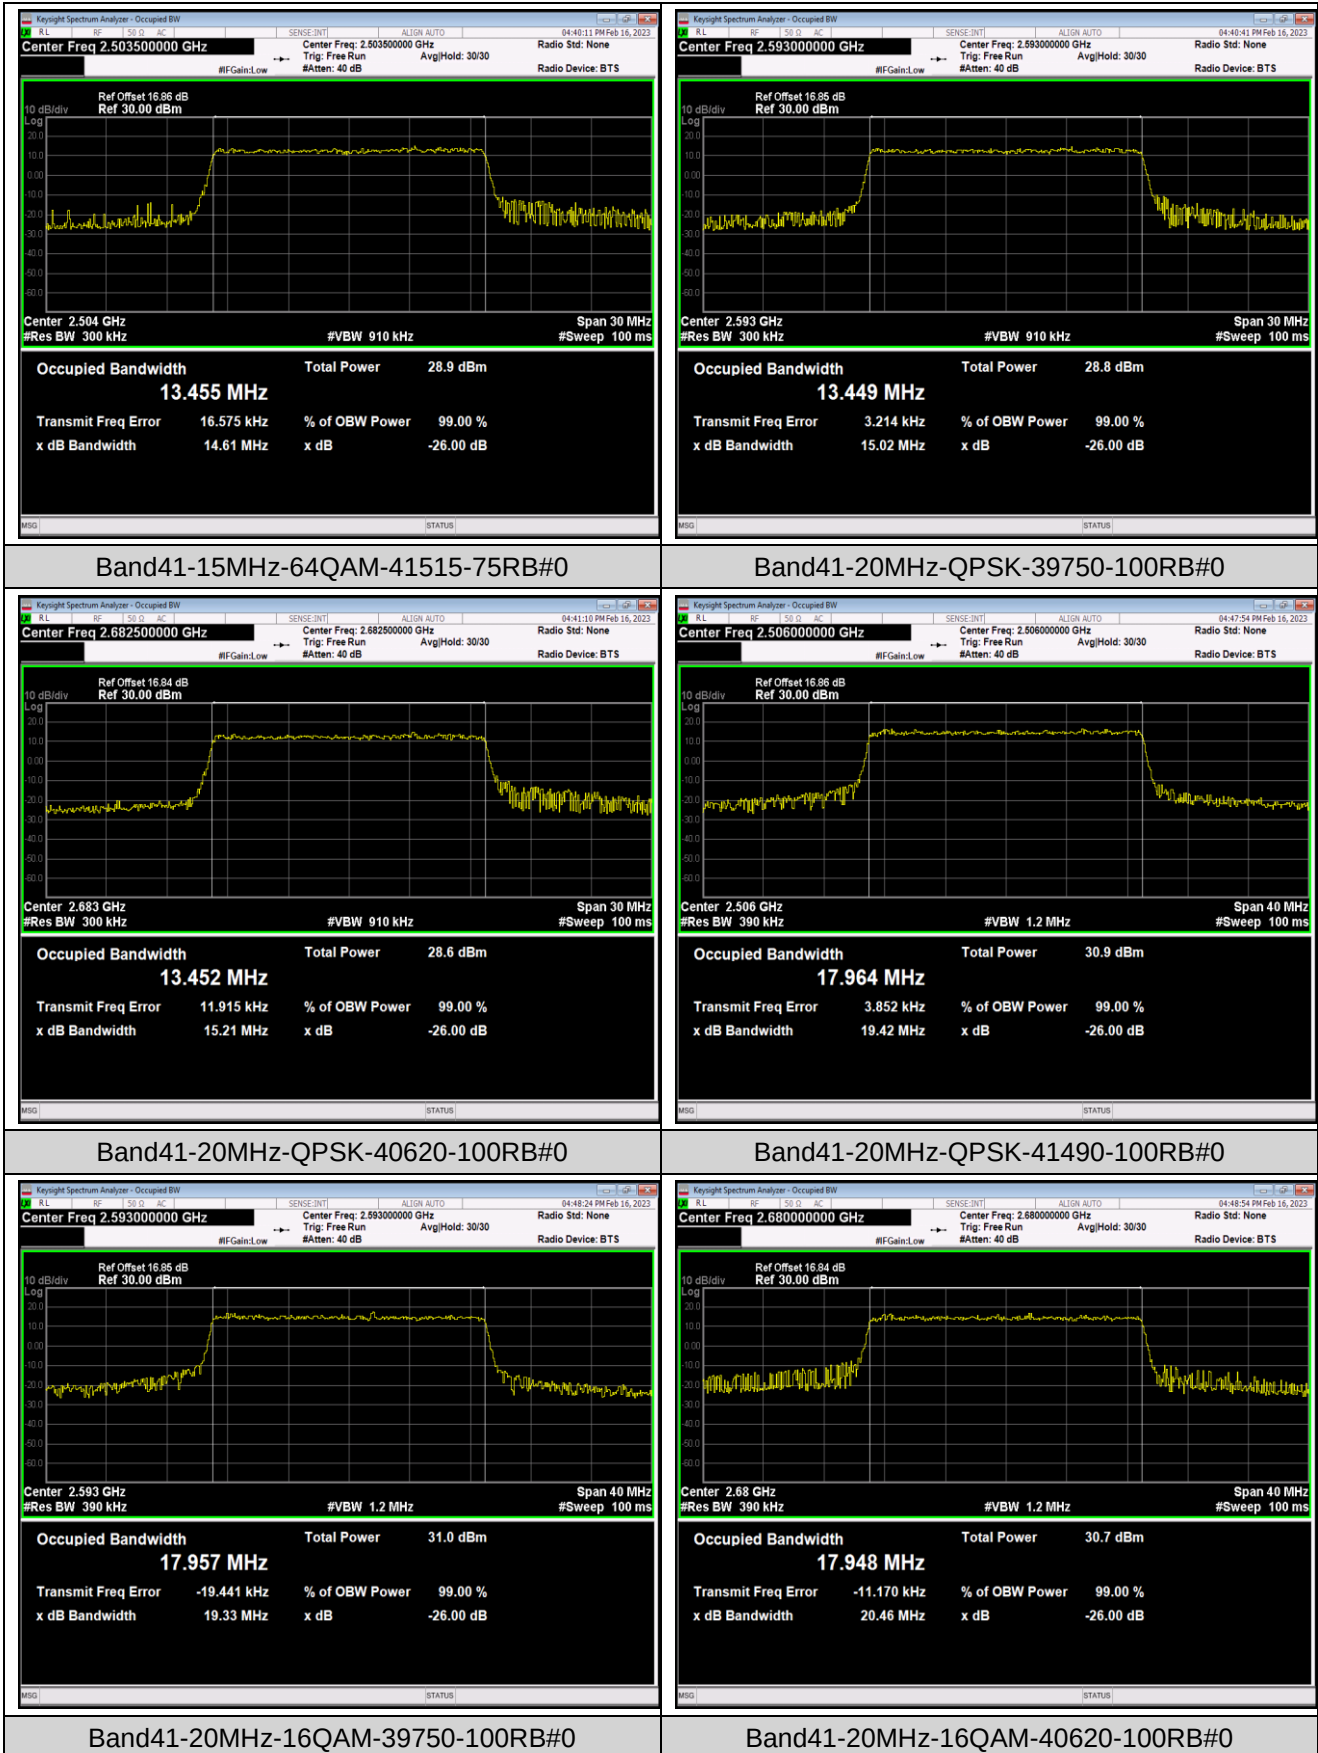



Appendix D: Band Edge


Test Result (worst case)

Band	Bandwidth	Modulation	Channel	RB Config.	Result (dBm)	Verdict
Band7	5MHz	QPSK	20775	1RB#0	-45.13,-43.60,-39.26,-26.79	PASS
Band7	5MHz	QPSK	20775	1RB#24	-45.46,-41.49,-41.39,-54.37	PASS
Band7	5MHz	QPSK	20775	25RB#0	-41.78,-34.68,-32.92,-34.69	PASS
Band7	5MHz	QPSK	21425	1RB#0	-54.95,-42.40,-44.71,-45.24	PASS
Band7	5MHz	QPSK	21425	1RB#24	-26.21,-39.19,-44.76,-44.96	PASS
Band7	5MHz	QPSK	21425	25RB#0	-33.90,-31.59,-39.09,-41.49	PASS
Band7	5MHz	16QAM	20775	1RB#0	-45.47,-43.91,-40.11,-25.41	PASS
Band7	5MHz	16QAM	20775	1RB#24	-45.56,-41.07,-41.40,-54.67	PASS
Band7	5MHz	16QAM	20775	25RB#0	-42.58,-37.20,-31.20,-35.96	PASS
Band7	5MHz	16QAM	21425	1RB#0	-53.93,-42.42,-44.77,-45.19	PASS
Band7	5MHz	16QAM	21425	1RB#24	-26.94,-39.71,-44.85,-45.23	PASS
Band7	5MHz	16QAM	21425	25RB#0	-35.06,-31.61,-39.93,-42.17	PASS
Band7	5MHz	64QAM	20775	1RB#0	-45.25,-44.33,-40.35,-28.00	PASS
Band7	5MHz	64QAM	20775	1RB#24	-45.65,-42.21,-42.10,-56.55	PASS
Band7	5MHz	64QAM	20775	25RB#0	-43.67,-39.05,-30.92,-35.57	PASS
Band7	5MHz	64QAM	21425	1RB#0	-55.27,-42.80,-44.83,-45.29	PASS
Band7	5MHz	64QAM	21425	1RB#24	-27.95,-40.07,-44.90,-45.27	PASS
Band7	5MHz	64QAM	21425	25RB#0	-36.64,-31.71,-41.58,-43.38	PASS
Band7	20MHz	QPSK	20850	1RB#0	-42.12,-42.21,-43.40	PASS
Band7	20MHz	QPSK	20850	1RB#99	-44.57,-44.87,-58.16	PASS
Band7	20MHz	QPSK	20850	100RB#0	-39.32,-37.72,-36.90,-39.85	PASS
Band7	20MHz	QPSK	21350	1RB#0	-57.60,-44.77,-44.98,-45.68	PASS
Band7	20MHz	QPSK	21350	1RB#99	-39.82,-41.51,-41.20,-45.62	PASS
Band7	20MHz	QPSK	21350	100RB#0	-38.89,-35.80,-37.57,-44.68	PASS
Band7	20MHz	16QAM	20850	1RB#0	-42.94,-42.67,-39.09	PASS
Band7	20MHz	16QAM	20850	1RB#99	-44.77,-45.03,-59.35	PASS
Band7	20MHz	16QAM	20850	100RB#0	-39.26,-37.17,-36.14,-39.37	PASS
Band7	20MHz	16QAM	21350	1RB#0	-59.09,-44.80,-44.88,-45.67	PASS
Band7	20MHz	16QAM	21350	1RB#99	-39.88,-41.80,-42.11,-45.67	PASS
Band7	20MHz	16QAM	21350	100RB#0	-39.37,-35.73,-38.10,-44.73	PASS
Band7	20MHz	64QAM	20850	1RB#0	-43.36,-42.94,-39.19	PASS
Band7	20MHz	64QAM	20850	1RB#99	-44.96,-45.21,-58.82	PASS
Band7	20MHz	64QAM	20850	100RB#0	-39.92,-37.50,-35.93,-39.84	PASS
Band7	20MHz	64QAM	21350	1RB#0	-58.46,-44.97,-45.10,-45.69	PASS
Band7	20MHz	64QAM	21350	1RB#99	-42.77,-42.53,-42.62,-45.73	PASS
Band7	20MHz	64QAM	21350	100RB#0	-39.75,-36.23,-38.63,-44.77	PASS


Band41	5MHz	QPSK	39675	1RB#0	-45.69,-45.57,-41.44,-28.95	PASS
Band41	5MHz	QPSK	39675	1RB#24	-45.86,-45.21,-42.86,-56.30	PASS
Band41	5MHz	QPSK	39675	25RB#0	-43.02,-40.70,-34.97,-38.75	PASS
Band41	5MHz	QPSK	41565	1RB#0	-56.50,-43.37,-44.61,-44.97	PASS
Band41	5MHz	QPSK	41565	1RB#24	-30.62,-41.09,-44.79,-45.00	PASS
Band41	5MHz	QPSK	41565	25RB#0	-36.06,-31.48,-40.47,-42.73	PASS
Band41	5MHz	16QAM	39675	1RB#0	-45.79,-45.61,-42.58,-29.72	PASS
Band41	5MHz	16QAM	39675	1RB#24	-45.85,-45.41,-43.21,-55.52	PASS
Band41	5MHz	16QAM	39675	25RB#0	-43.77,-41.49,-33.23,-38.73	PASS
Band41	5MHz	16QAM	41565	1RB#0	-57.12,-43.04,-44.73,-45.02	PASS
Band41	5MHz	16QAM	41565	1RB#24	-29.53,-41.52,-44.83,-44.94	PASS
Band41	5MHz	16QAM	41565	25RB#0	-37.02,-30.66,-41.22,-43.10	PASS
Band41	5MHz	64QAM	39675	1RB#0	-45.83,-45.64,-43.04,-32.33	PASS
Band41	5MHz	64QAM	39675	1RB#24	-45.89,-45.53,-43.80,-58.21	PASS
Band41	5MHz	64QAM	39675	25RB#0	-45.94,-45.95,-45.95,-55.37	PASS
Band41	5MHz	64QAM	41565	1RB#0	-58.96,-43.57,-44.88,-45.08	PASS
Band41	5MHz	64QAM	41565	1RB#24	-29.11,-42.49,-44.85,-45.02	PASS
Band41	5MHz	64QAM	41565	25RB#0	-37.89,-31.65,-42.70,-43.89	PASS
Band41	20MHz	QPSK	39750	1RB#0	-46.27,-43.75,-44.33,-41.38	PASS
Band41	20MHz	QPSK	39750	1RB#99	-46.27,-45.55,-45.78,-60.28	PASS
Band41	20MHz	QPSK	39750	100RB#0	-45.74,-40.90,-39.61,-43.11	PASS
Band41	20MHz	QPSK	41490	1RB#0	-59.60,-44.88,-44.94,-45.58	PASS
Band41	20MHz	QPSK	41490	1RB#99	-41.92,-43.67,-42.59,-45.58	PASS
Band41	20MHz	QPSK	41490	100RB#0	-40.03,-37.10,-38.50,-44.54	PASS
Band41	20MHz	16QAM	39750	1RB#0	-46.29,-44.06,-44.54,-42.47	PASS
Band41	20MHz	16QAM	39750	1RB#99	-46.29,-45.64,-45.80,-61.61	PASS
Band41	20MHz	16QAM	39750	100RB#0	-45.97,-40.96,-38.97,-43.13	PASS
Band41	20MHz	16QAM	41490	1RB#0	-59.28,-44.96,-44.99,-45.59	PASS
Band41	20MHz	16QAM	41490	1RB#99	-44.53,-43.89,-43.03,-45.59	PASS
Band41	20MHz	16QAM	41490	100RB#0	-41.00,-37.36,-39.06,-45.12	PASS
Band41	20MHz	64QAM	39750	1RB#0	-46.30,-44.59,-44.72,-43.93	PASS
Band41	20MHz	64QAM	39750	1RB#99	-46.29,-45.76,-45.86,-61.71	PASS
Band41	20MHz	64QAM	39750	100RB#0	-46.14,-40.79,-39.00,-42.54	PASS
Band41	20MHz	64QAM	41490	1RB#0	-60.65,-45.00,-45.06,-45.61	PASS
Band41	20MHz	64QAM	41490	1RB#99	-42.48,-44.08,-43.83,-45.61	PASS
Band41	20MHz	64QAM	41490	100RB#0	-41.31,-37.15,-39.57,-45.28	PASS

Remark: All bandwidth and all modulation had been tested, but only the worst case data displayed in this report.


Test Graphs

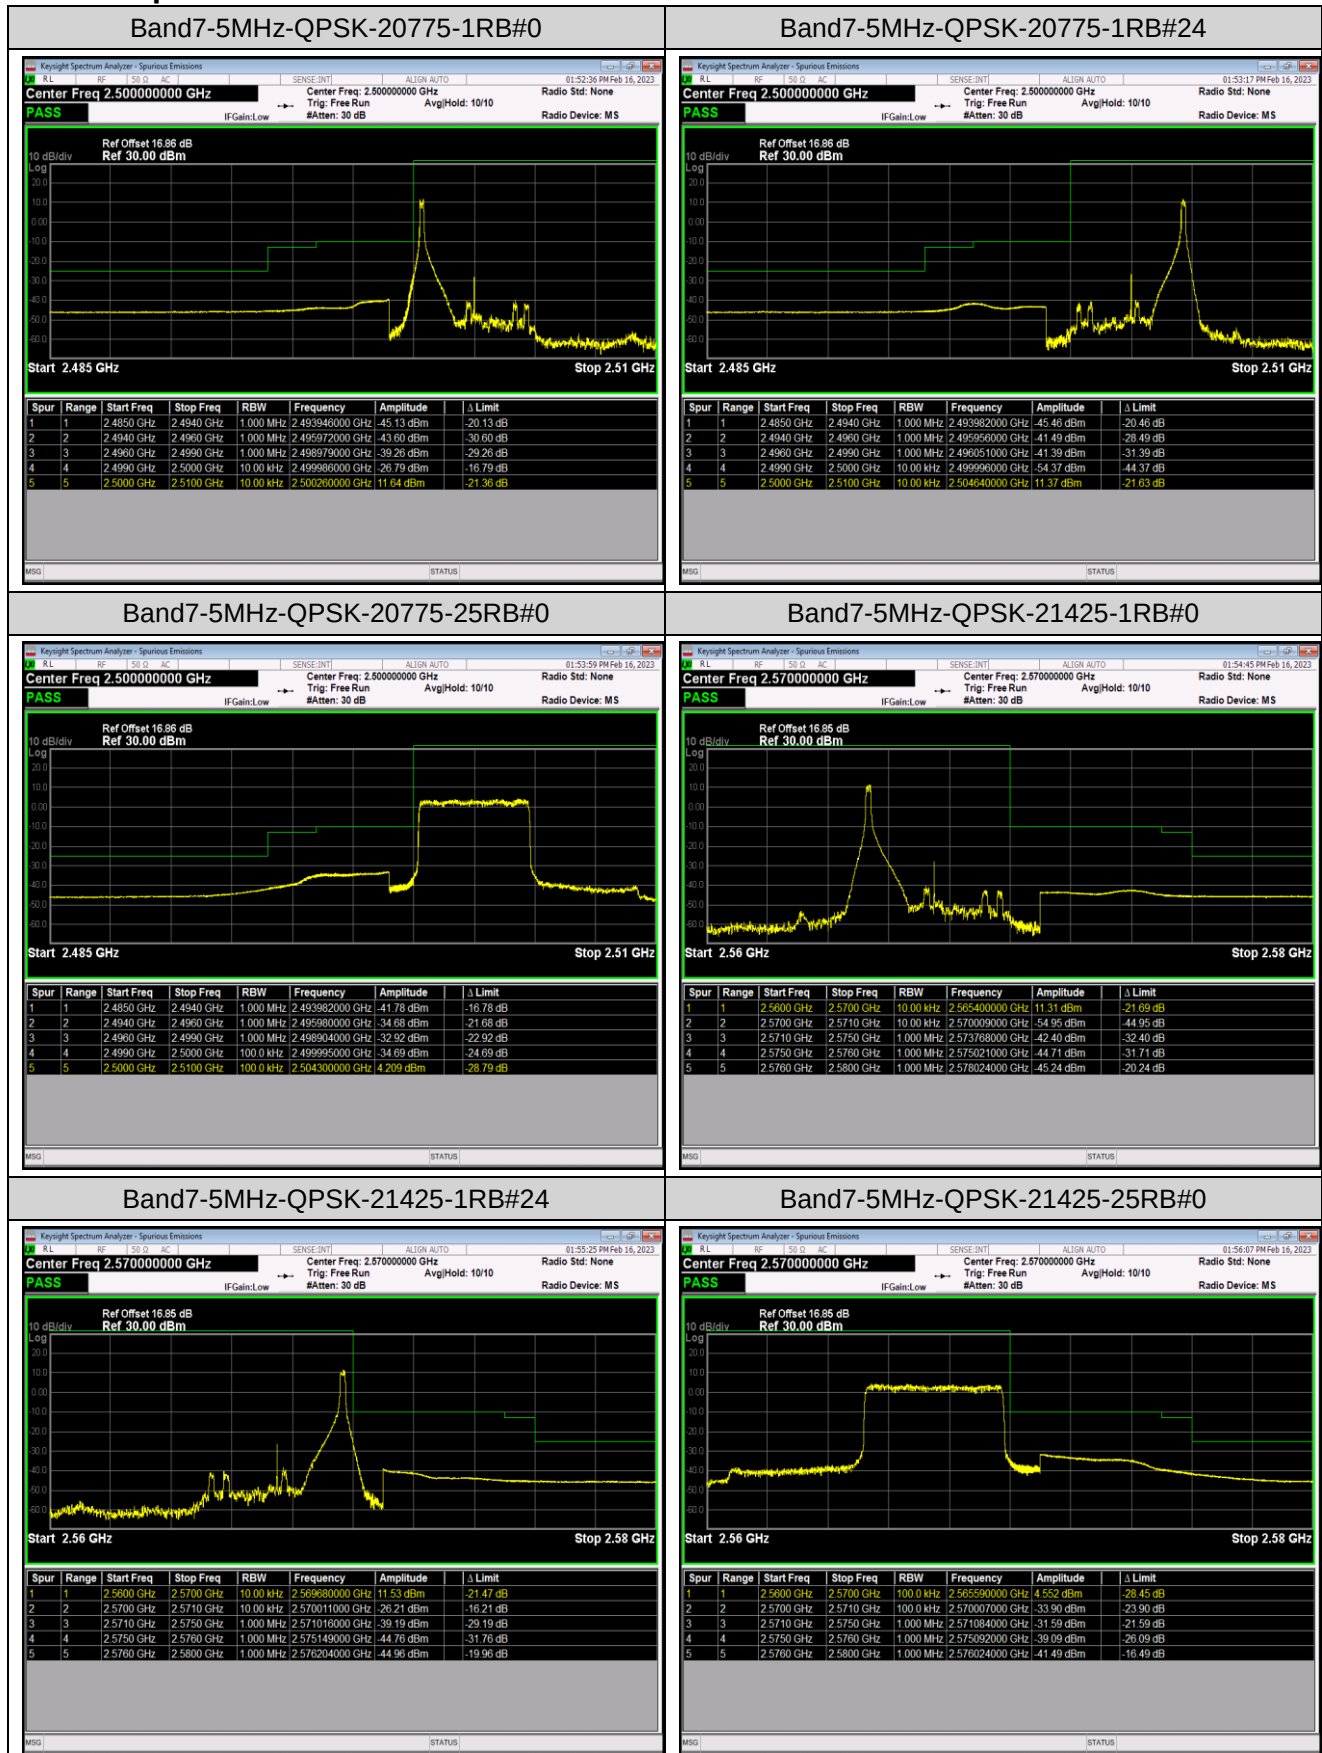


Band7-5MHz-16QAM-20775-1RB#0

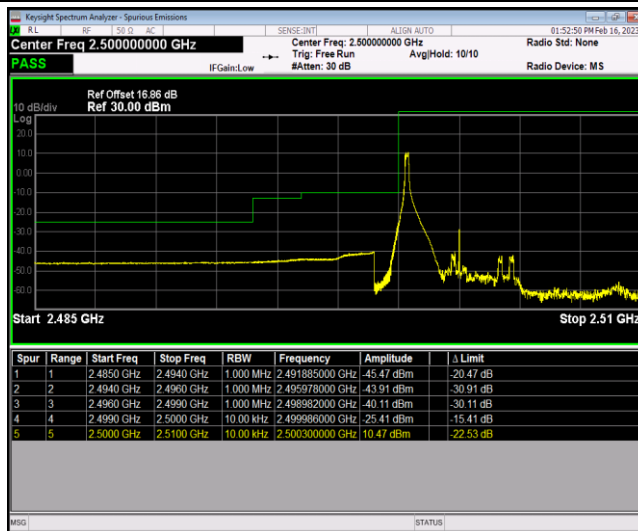


Band7-5MHz-16QAM-20775-1RB#24

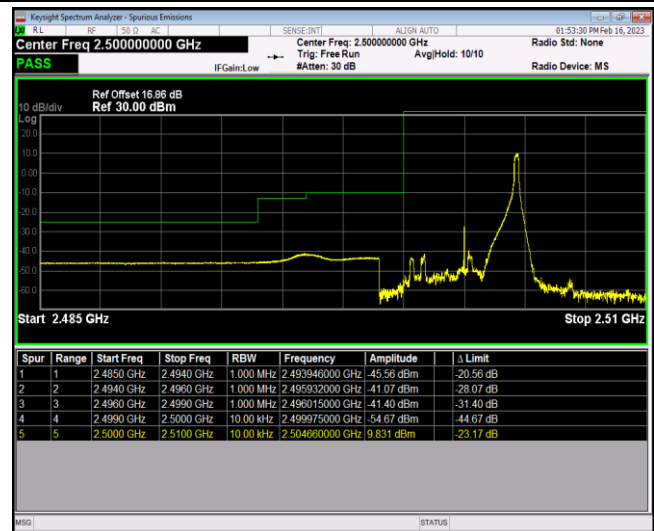


Band7-5MHz-16QAM-20775-25RB#0

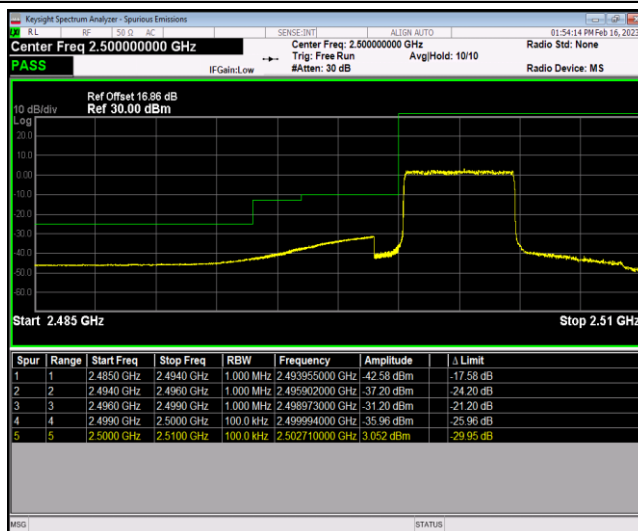


Band7-5MHz-16QAM-21425-1RB#0

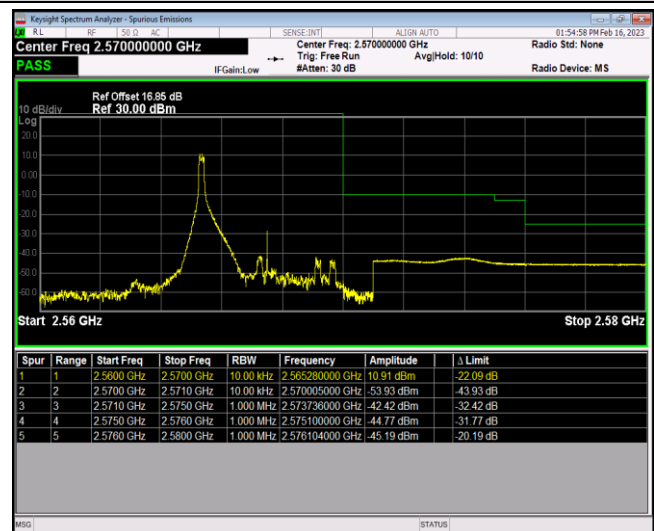

Band7-5MHz-16QAM-21425-1RB#24

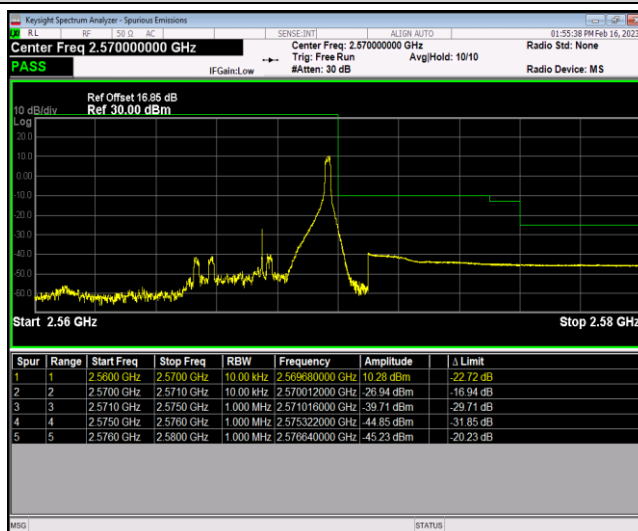

Band7-5MHz-16QAM-21425-25RB#0

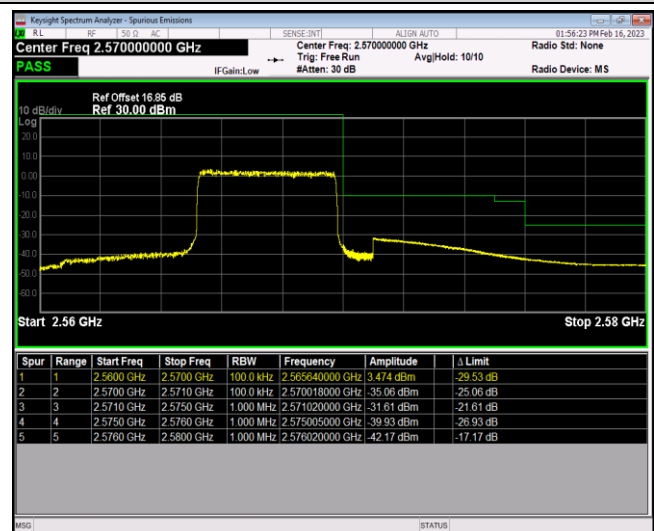

Band7-5MHz-64QAM-20775-1RB#0

JianYan Testing Group Shenzhen Co., Ltd.
No.101, Building 8, Innovation Wisdom Port, No.155 Hongtian Road, Huangpu Community,
Xinqiao Street, Bao'an District, Shenzhen, Guangdong, People's Republic of China.
Tel: +86-755-23118282, Fax: +86-755-23116366

Band7-5MHz-64QAM-20775-1RB#24

Project No.: JYTSZR2301033

