




Test report No. : 4790224862-US-R1-V0
Page : 130 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11a	Channel	157
------	---------	---------	-----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal	@	5535	43.54	19.82	63.36	68.2	-4.84	PK
		5654.5	41.39	19.67	61.06	71.54	-10.48	PK
		5785	87.86	20.45	108.31	N/A	N/A	PK
		5878	41.13	20.82	61.95	102.97	-41.02	PK
		5987.5	40.04	20.98	61.02	68.2	-7.18	PK
	*	11570	29.24	19.07	48.31	74	-25.69	PK
Vertical	@	5535	40.75	19.82	60.57	68.2	-7.63	PK
		5675.5	40.15	19.7	59.85	87.11	-27.26	PK
		5785	83.98	20.45	104.43	N/A	N/A	PK
		5922	40.22	20.96	61.18	70.41	-9.23	PK
		5952	40.34	20.95	61.29	68.2	-6.91	PK
	*	11570	30.03	19.07	49.1	74	-24.9	PK

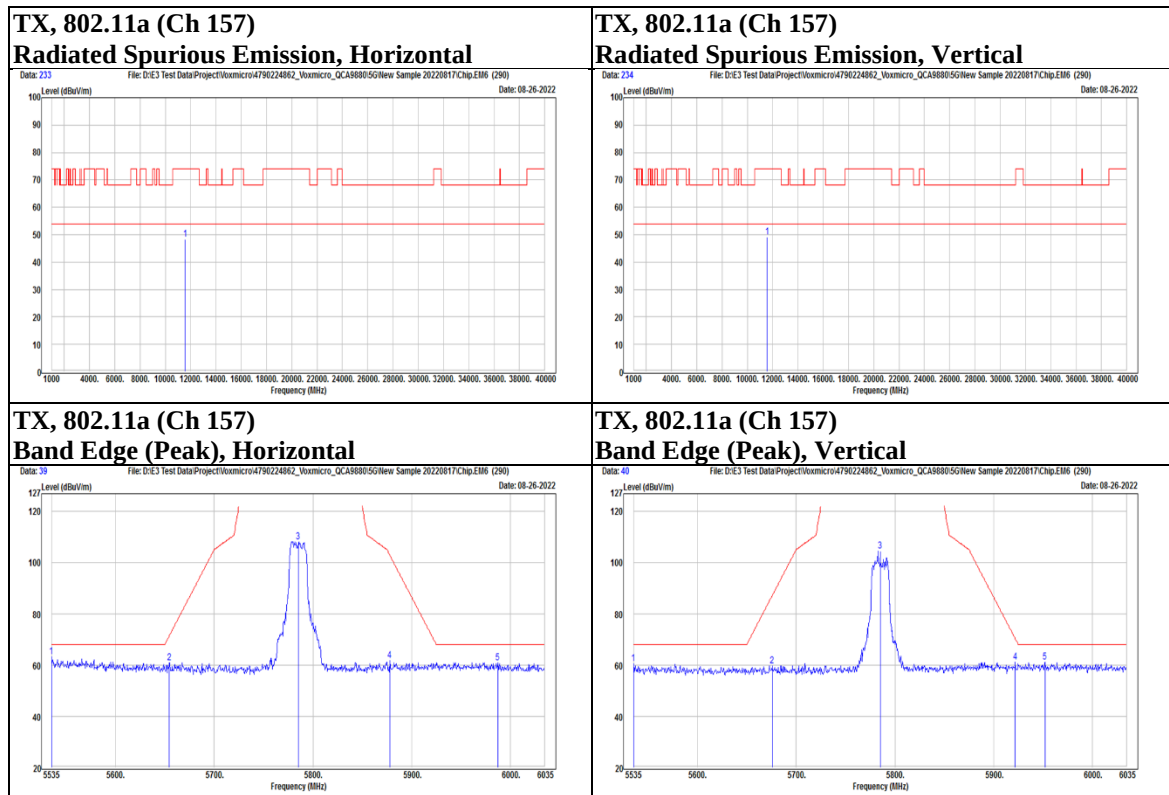

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948


Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790224862-US-R1-V0
Page : 131 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11a	Channel	165
------	---------	---------	-----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal	@	5825	86.33	20.58	106.91	N/A	N/A	PK
		5880.5	40.66	20.84	61.5	101.11	-39.61	PK
		5943.5	40.23	20.94	61.17	68.2	-7.03	PK
	*	11650	29.93	18.83	48.76	74	-25.24	PK
Vertical	@	5825	79.61	20.58	100.19	N/A	N/A	PK
		5922	41.51	20.96	62.47	70.41	-7.94	PK
		5943	41.19	20.94	62.13	68.2	-6.07	PK
	*	11650	28.54	18.83	47.37	74	-26.63	PK

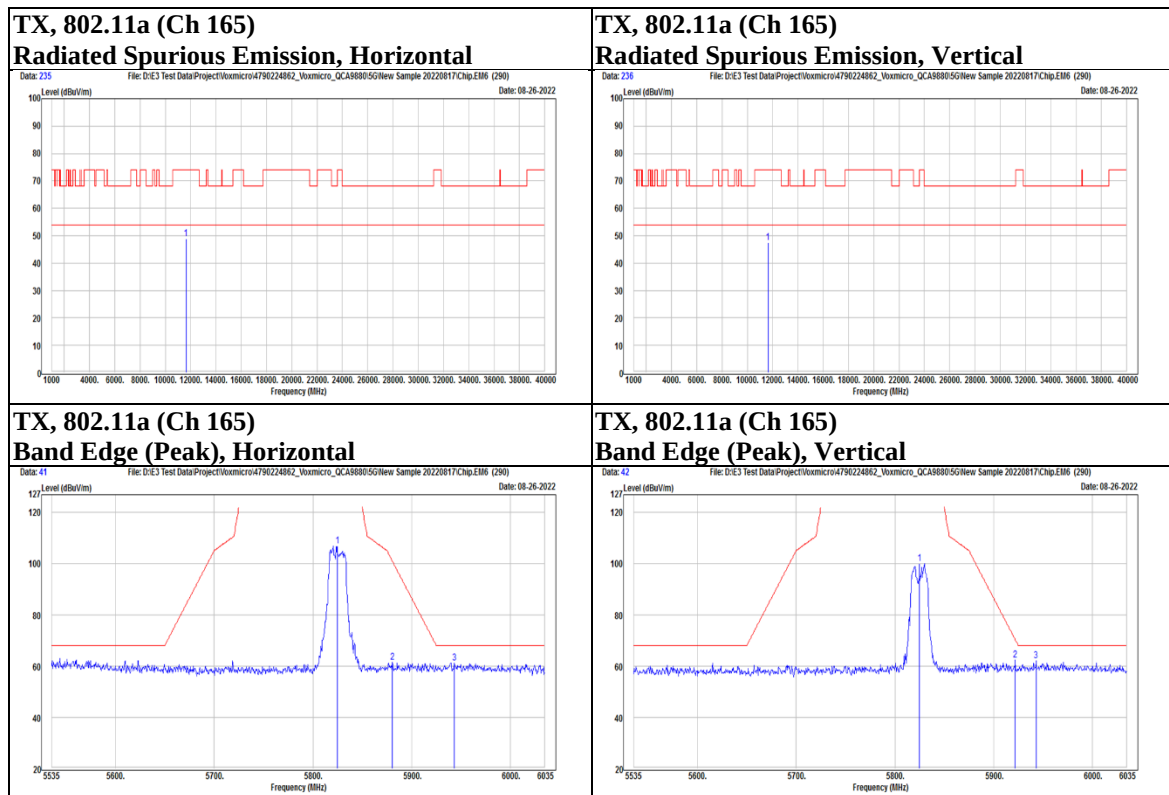

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790224862-US-R1-V0
Page : 132 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11ac(VHT20)	Channel	36
------	-----------------	---------	----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		5081.2	30.5	19.31	49.81	54	-4.19	AVG
		5116.55	43.93	19.43	63.36	74	-10.64	PK
	@	5180	90.81	19.31	110.12	N/A	N/A	PK
	@	5180	80.48	19.31	99.79	N/A	N/A	AVG
	*	10360	29.89	17.51	47.4	68.2	-20.8	PK
Vertical		5099.75	30.13	19.44	49.57	54	-4.43	AVG
		5137.9	42.74	19.4	62.14	74	-11.86	PK
	@	5180	79.95	19.31	99.26	N/A	N/A	PK
	@	5180	70.39	19.31	89.7	N/A	N/A	AVG
	*	10360	29.55	17.51	47.06	68.2	-21.14	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790224862-US-R1-V0
Page : 133 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

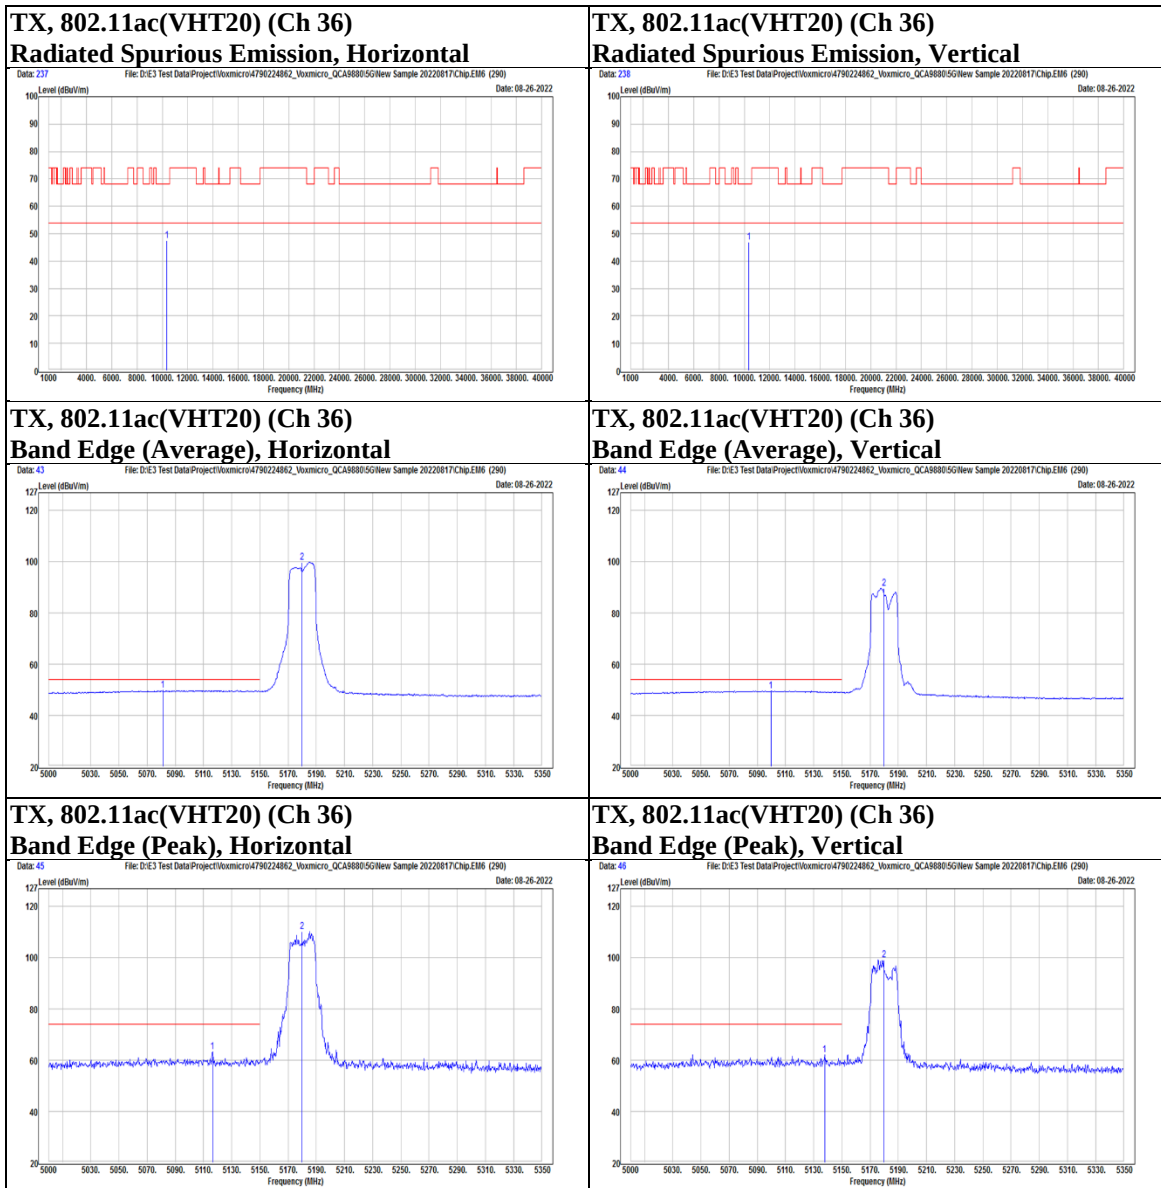

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790224862-US-R1-V0
Page : 134 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11ac(VHT20)	Channel	44
------	-----------------	---------	----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		5086.1	42.17	19.35	61.52	74	-12.48	PK
		5116.55	30.28	19.43	49.71	54	-4.29	AVG
	@	5220	90.35	19.12	109.47	N/A	N/A	PK
	@	5220	80.53	19.12	99.65	N/A	N/A	AVG
	*	10440	29.19	17.81	47	68.2	-21.2	PK
Vertical		5060.55	30.37	19.16	49.53	54	-4.47	AVG
		5117.95	41.95	19.43	61.38	74	-12.62	PK
	@	5220	79.68	19.12	98.8	N/A	N/A	PK
	@	5220	70.63	19.12	89.75	N/A	N/A	AVG
	*	10440	29.12	17.81	46.93	68.2	-21.27	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790224862-US-R1-V0
Page : 135 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

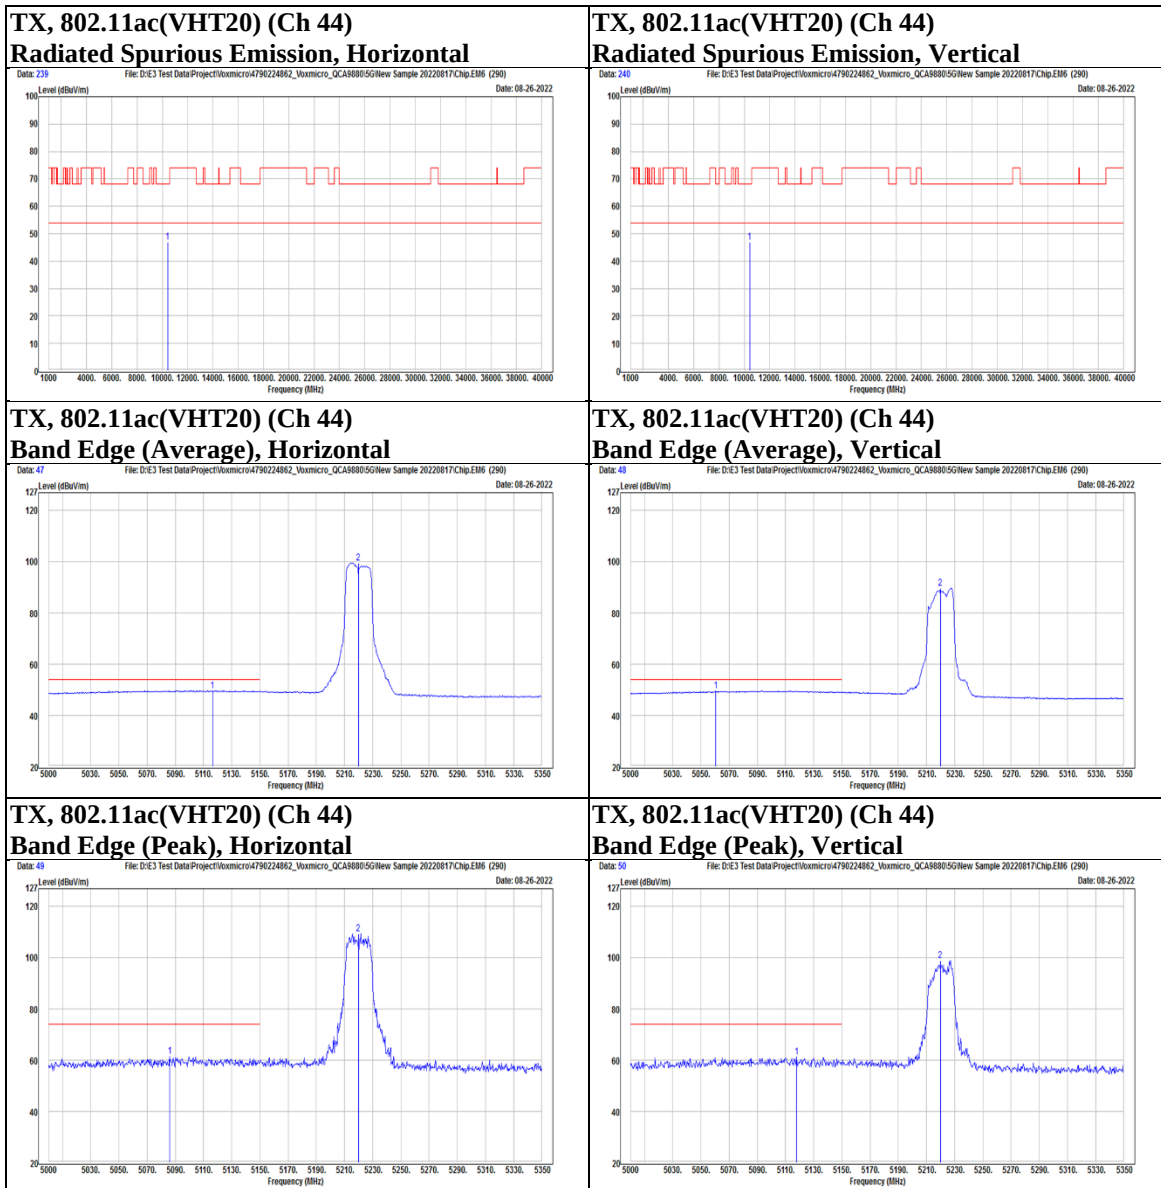

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790224862-US-R1-V0
Page : 136 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11ac(VHT20)	Channel	48
------	-----------------	---------	----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		5063	42.81	19.18	61.99	74	-12.01	PK
		5115.15	30.31	19.43	49.74	54	-4.26	AVG
	@	5240	88.46	18.97	107.43	N/A	N/A	PK
	@	5240	79.59	18.97	98.56	N/A	N/A	AVG
	*	10480	29.86	17.92	47.78	68.2	-20.42	PK
Vertical		5025.9	43.36	18.87	62.23	74	-11.77	PK
		5105	30.16	19.44	49.6	54	-4.4	AVG
	@	5240	80.53	18.97	99.5	N/A	N/A	PK
	@	5240	70.2	18.97	89.17	N/A	N/A	AVG
	*	10480	28.82	17.92	46.74	68.2	-21.46	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790224862-US-R1-V0
Page : 137 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

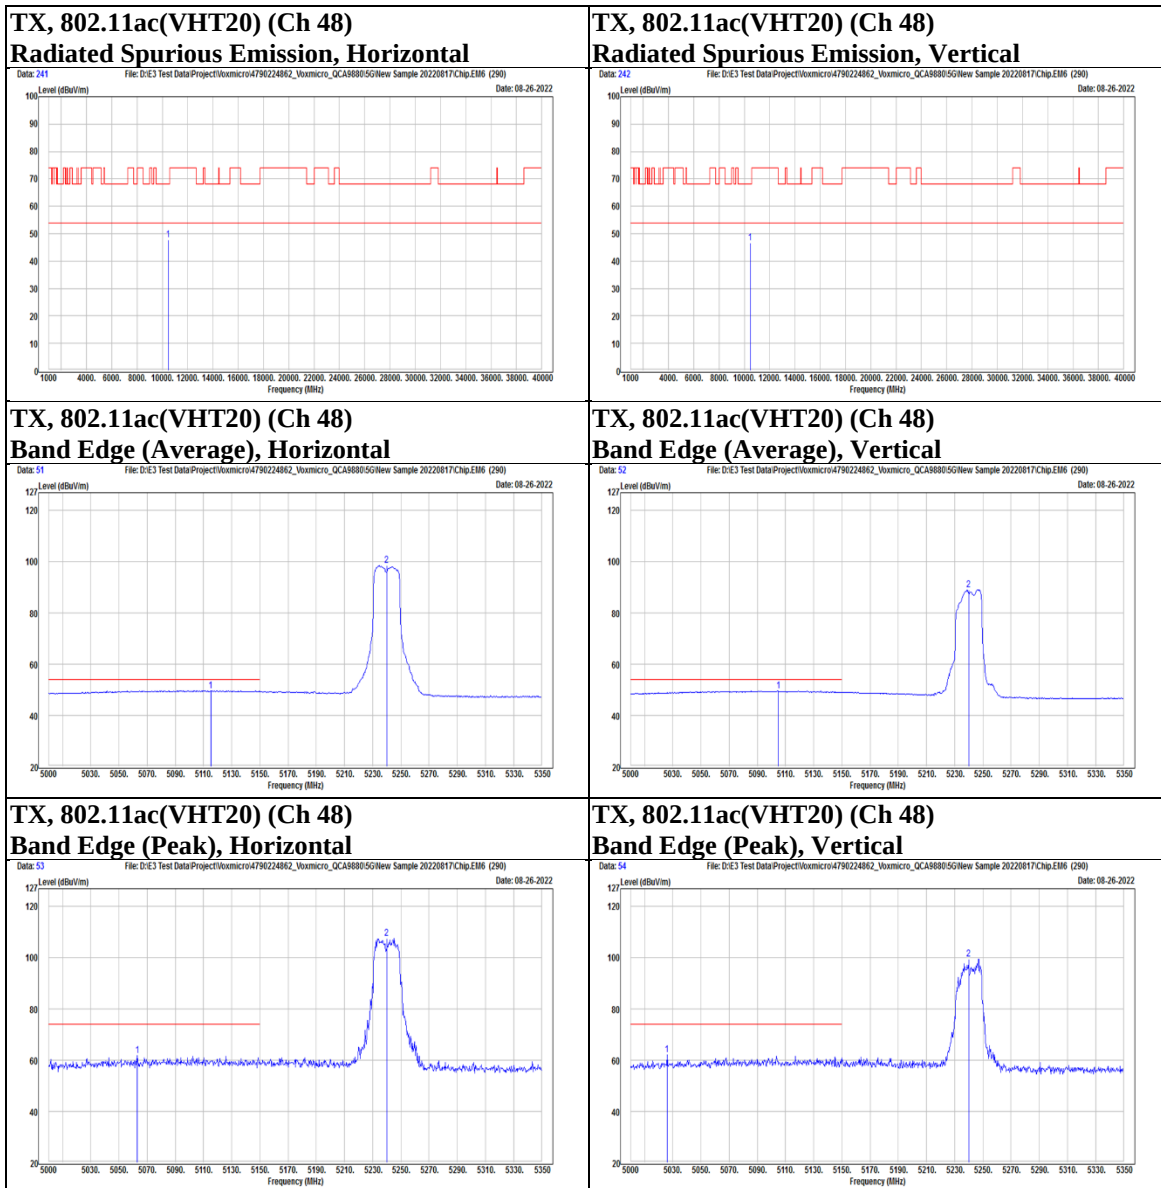

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790224862-US-R1-V0
Page : 138 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11ac(VHT20)	Channel	52
------	-----------------	---------	----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal	@	5260	90.46	18.88	109.34	N/A	N/A	PK
	@	5260	80.16	18.88	99.04	N/A	N/A	AVG
		5417.7	40.99	19.35	60.34	74	-13.66	PK
		5449.2	29.03	19.51	48.54	54	-5.46	AVG
	*	10520	29.39	17.99	47.38	68.2	-20.82	PK
Vertical	@	5260	80.17	18.88	99.05	N/A	N/A	PK
	@	5260	70.62	18.88	89.5	N/A	N/A	AVG
		5356.8	40.28	19.05	59.33	74	-14.67	PK
		5454.6	28.36	19.54	47.9	54	-6.1	AVG
	*	10520	29.07	17.99	47.06	68.2	-21.14	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790224862-US-R1-V0
Page : 139 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

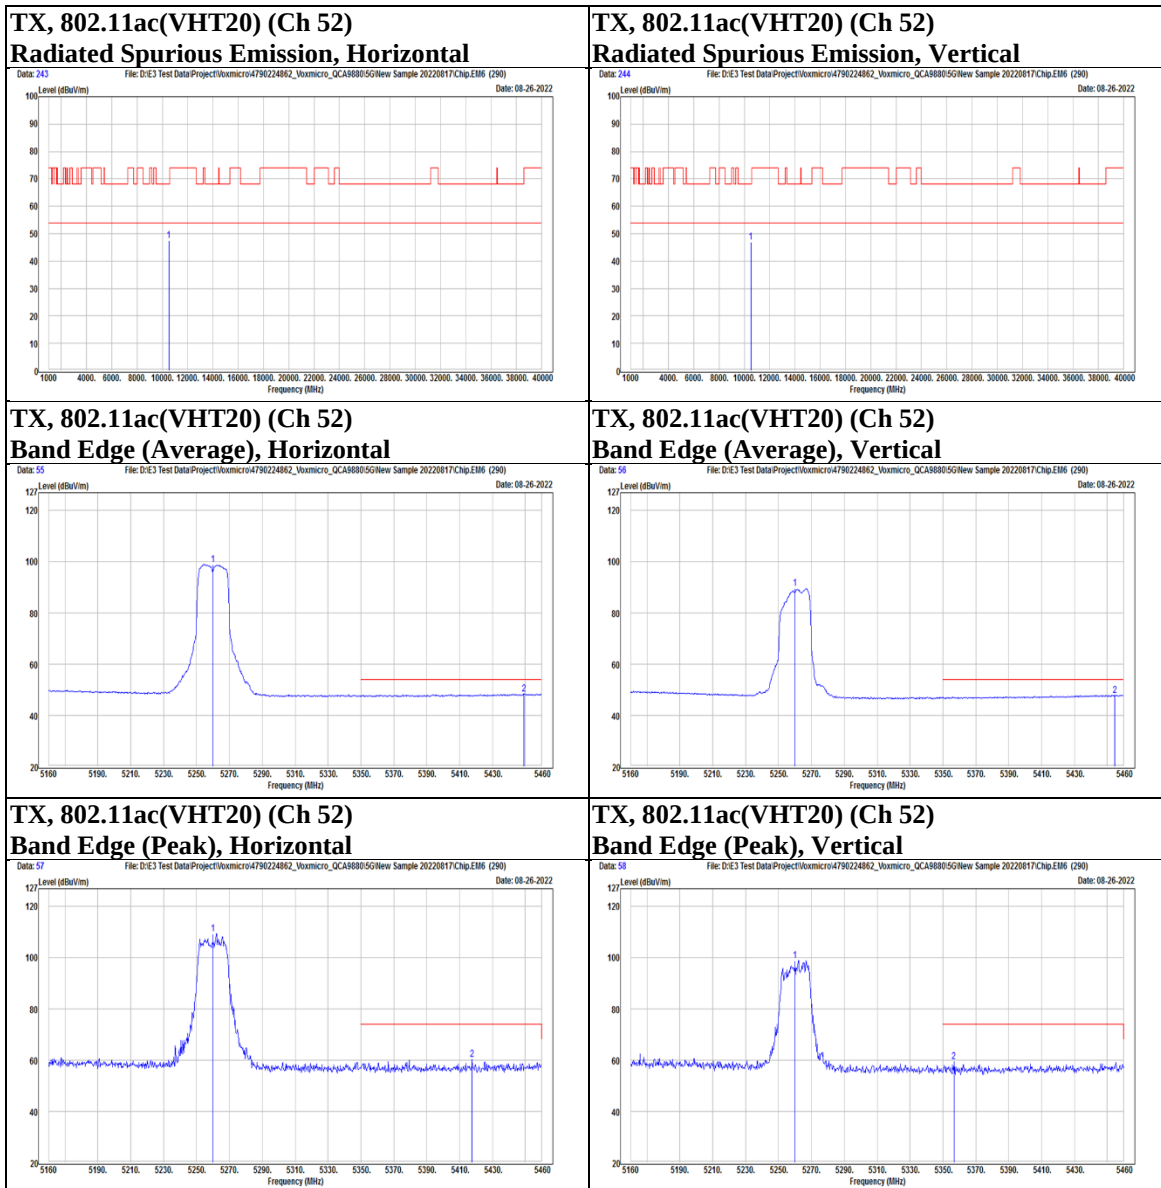

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790224862-US-R1-V0
Page : 140 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11ac(VHT20)	Channel	60
------	-----------------	---------	----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal	@	5300	90.03	18.77	108.8	N/A	N/A	PK
	@	5300	80.58	18.77	99.35	N/A	N/A	AVG
		5449.2	29.24	19.51	48.75	54	-5.25	AVG
		5459.7	39.98	19.57	59.55	74	-14.45	PK
	*	10600	29.58	18.04	47.62	68.2	-20.58	PK
Vertical	@	5300	80.27	18.77	99.04	N/A	N/A	PK
	@	5300	71.25	18.77	90.02	N/A	N/A	AVG
		5415	39.89	19.34	59.23	74	-14.77	PK
		5451.9	28.39	19.53	47.92	54	-6.08	AVG
	*	10600	29.33	18.04	47.37	68.2	-20.83	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790224862-US-R1-V0
Page : 141 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

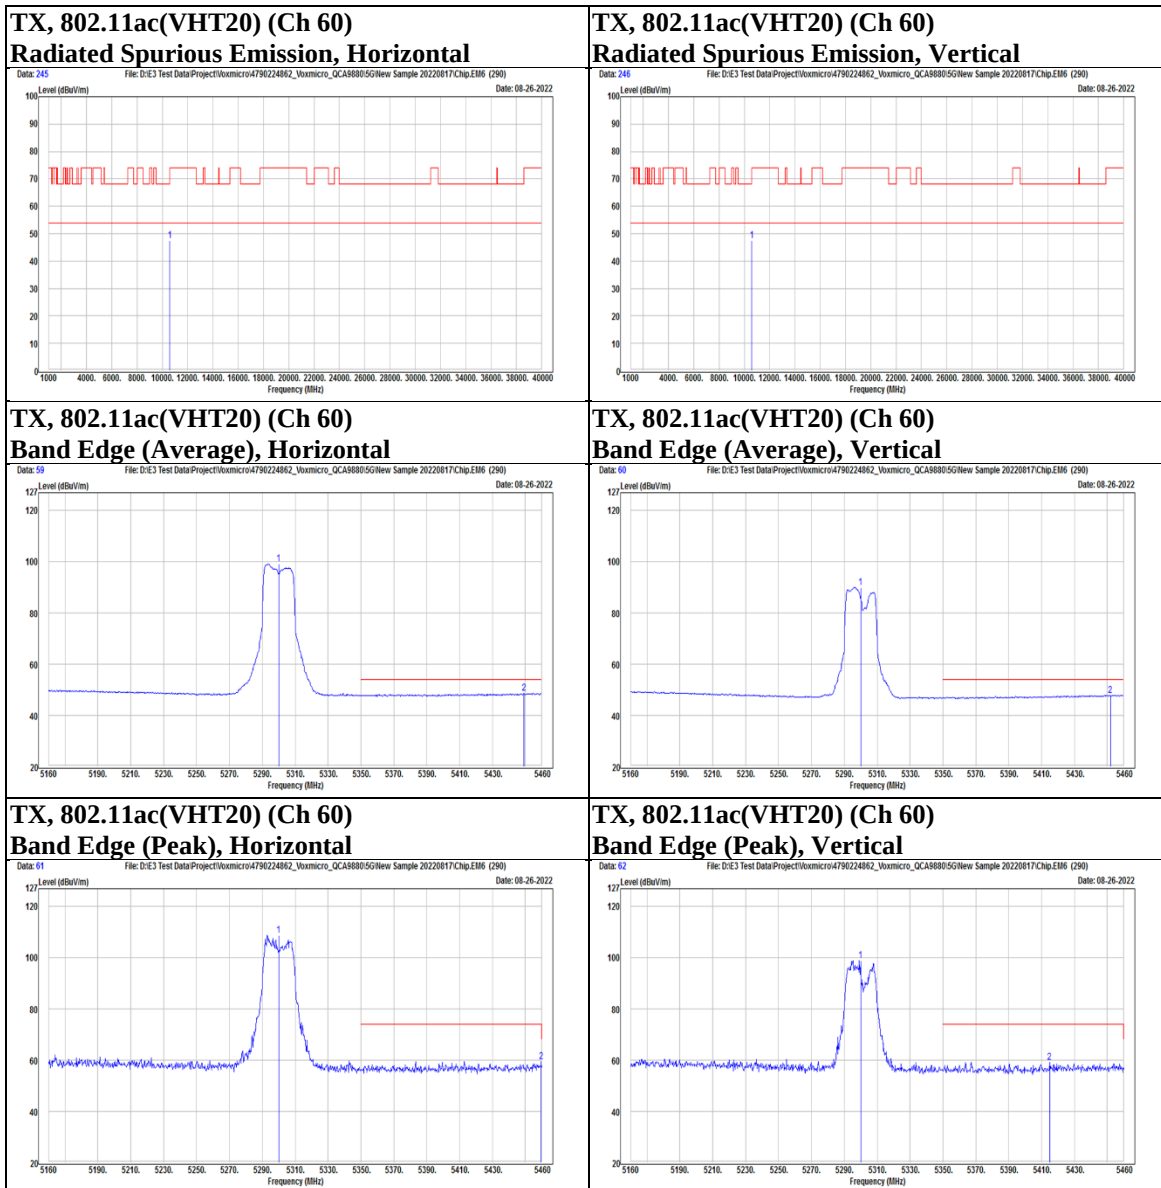

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790224862-US-R1-V0
Page : 142 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11ac(VHT20)	Channel	64
------	-----------------	---------	----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal	@	5320	89.54	18.86	108.4	N/A	N/A	PK
	@	5320	80.59	18.86	99.45	N/A	N/A	AVG
		5448.6	28.93	19.5	48.43	54	-5.57	AVG
		5452.8	39.28	19.53	58.81	74	-15.19	PK
	*	10640	29.7	18.03	47.73	74	-26.27	PK
Vertical	@	5320	81.92	18.86	100.78	N/A	N/A	PK
	@	5320	71.74	18.86	90.6	N/A	N/A	AVG
		5374.2	40.54	19.14	59.68	74	-14.32	PK
		5451.6	28.35	19.53	47.88	54	-6.12	AVG
	*	10640	29.3	18.03	47.33	74	-26.67	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790224862-US-R1-V0
Page : 143 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

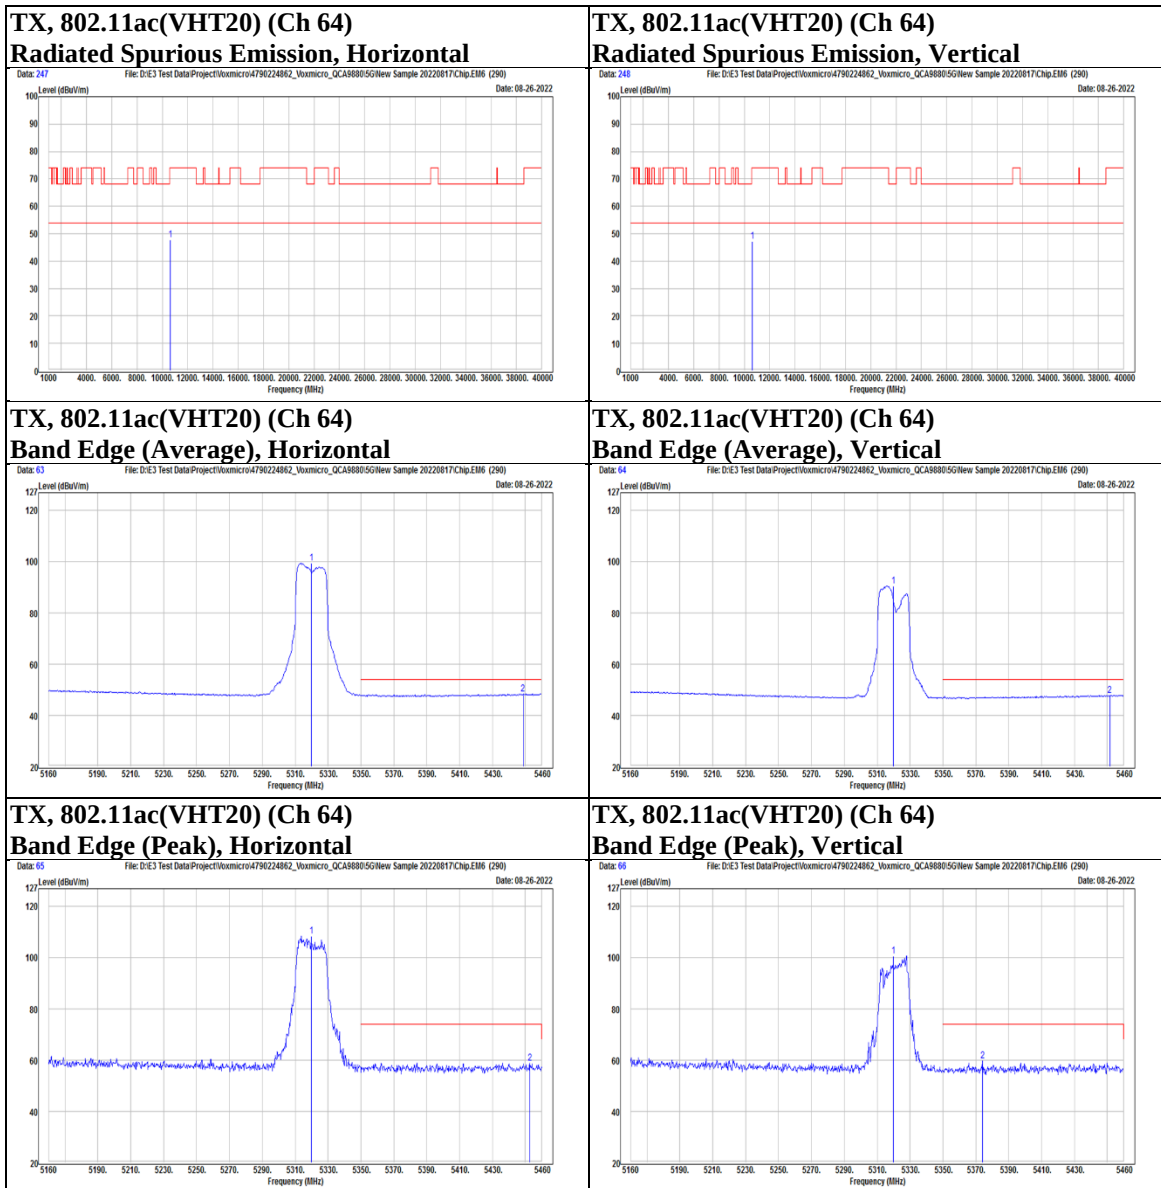

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790224862-US-R1-V0
Page : 144 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11ac(VHT20)	Channel	100
------	-----------------	---------	-----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		5443.4	40.13	19.49	59.62	74	-14.38	PK
		5454.6	29.58	19.54	49.12	54	-4.88	AVG
		5470	39.52	19.62	59.14	68.2	-9.06	PK
	@	5500	87.71	19.77	107.48	N/A	N/A	PK
	@	5500	79.49	19.77	99.26	N/A	N/A	AVG
	*	11000	30.4	18.41	48.81	74	-25.19	PK
Vertical		5428.7	41.02	19.41	60.43	74	-13.57	PK
		5455.65	28.53	19.54	48.07	54	-5.93	AVG
		5460.2	38.19	19.57	57.76	68.2	-10.44	PK
	@	5500	81.34	19.77	101.11	N/A	N/A	PK
	@	5500	74.23	19.77	94	N/A	N/A	AVG
	*	11000	29.91	18.41	48.32	74	-25.68	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790224862-US-R1-V0
Page : 145 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

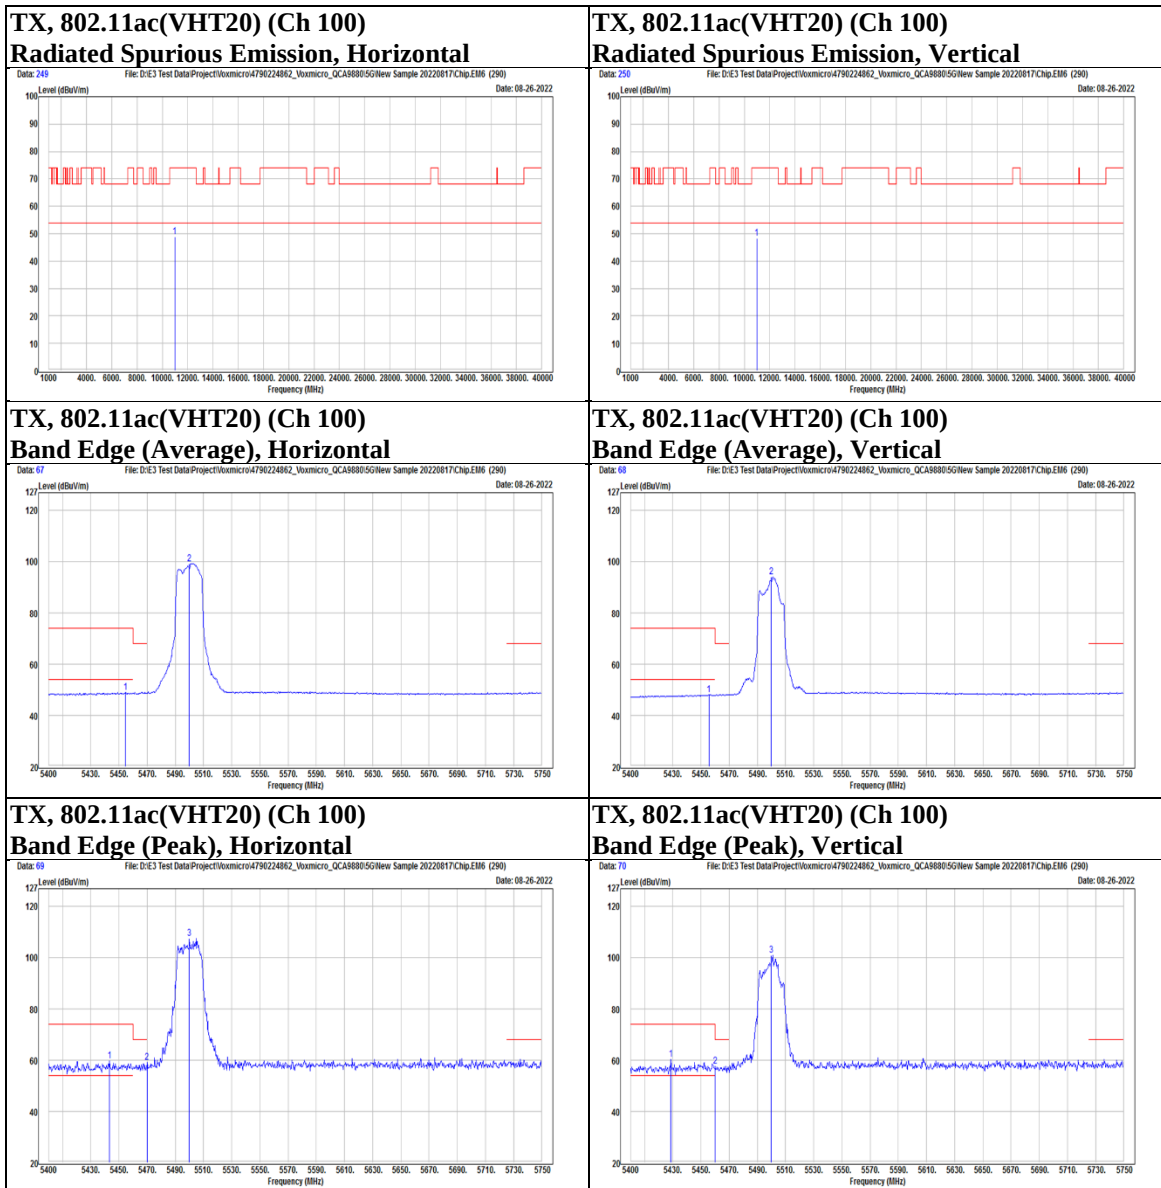

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790224862-US-R1-V0
Page : 146 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11ac(VHT20)	Channel	116
------	-----------------	---------	-----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		5453.2	30.22	19.53	49.75	54	-4.25	AVG
		5456.35	40.35	19.55	59.9	74	-14.1	PK
		5461.95	40.43	19.58	60.01	68.2	-8.19	PK
	@	5580	87.28	19.76	107.04	N/A	N/A	PK
	@	5580	77.99	19.76	97.75	N/A	N/A	AVG
		5738.8	40.27	20.09	60.36	68.2	-7.84	PK
	*	11160	30.91	18.47	49.38	74	-24.62	PK
Vertical		5439.9	28.81	19.47	48.28	54	-5.72	AVG
		5443.05	40.46	19.49	59.95	74	-14.05	PK
		5467.9	39.19	19.61	58.8	68.2	-9.4	PK
	@	5580	79.05	19.76	98.81	N/A	N/A	PK
	@	5580	70.52	19.76	90.28	N/A	N/A	AVG
		5748.25	40.34	20.19	60.53	68.2	-7.67	PK
	*	11160	29.9	18.47	48.37	74	-25.63	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790224862-US-R1-V0
Page : 147 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

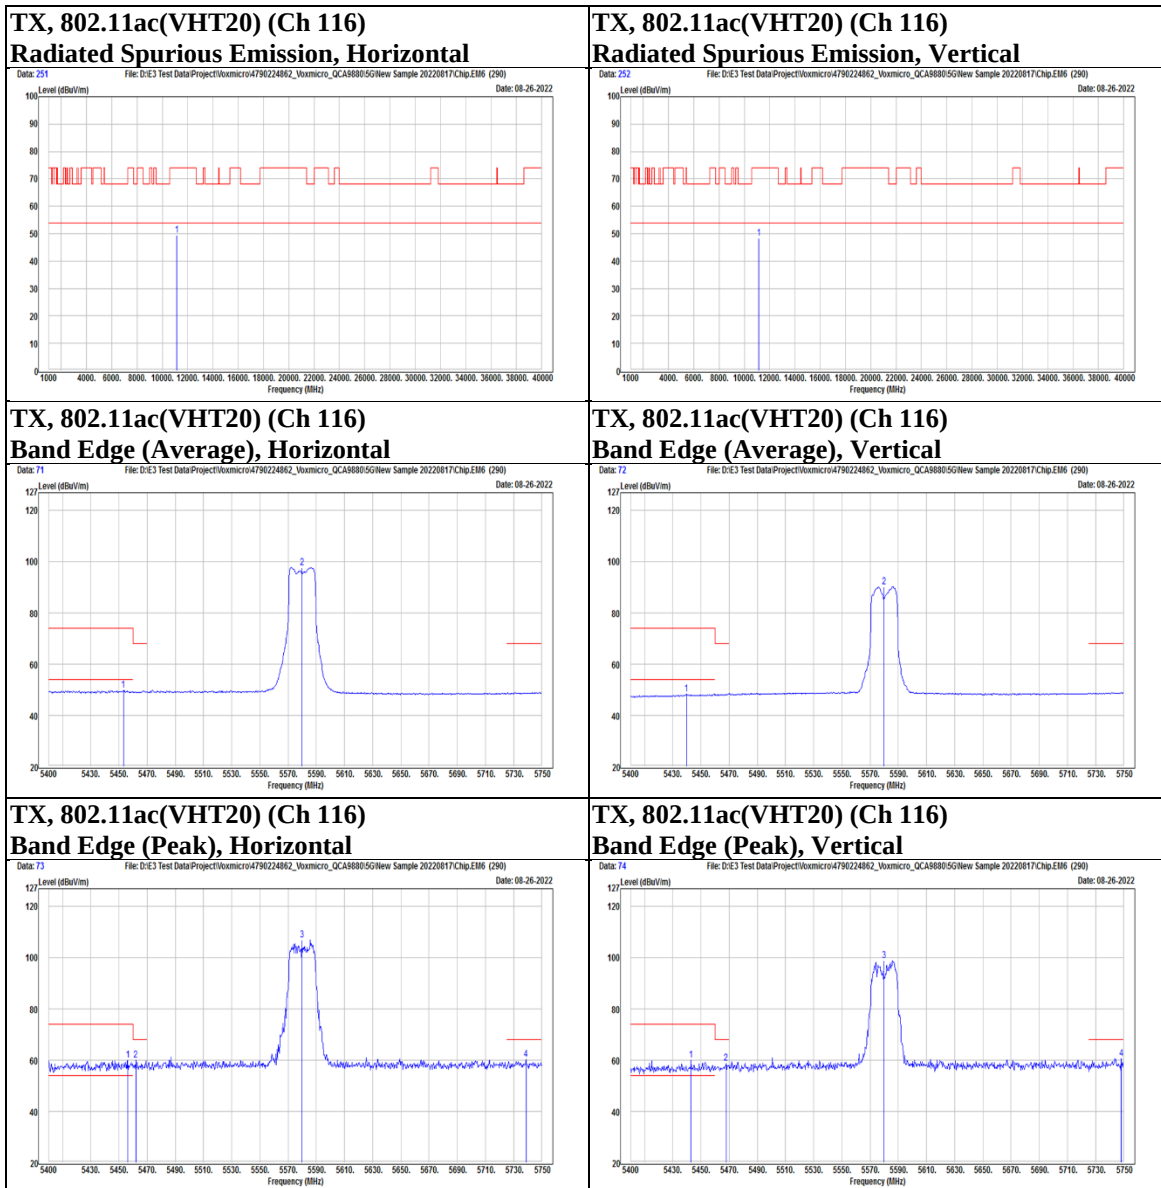

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790224862-US-R1-V0
Page : 148 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11ac(VHT20)	Channel	140
------	-----------------	---------	-----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		5456.7	29.49	19.55	49.04	54	-4.96	AVG
	@	5700	81.51	19.73	101.24	N/A	N/A	PK
	@	5700	70.99	19.73	90.72	N/A	N/A	AVG
		5745.1	39.82	20.15	59.97	68.2	-8.23	PK
	*	11400	30.68	18.85	49.53	74	-24.47	PK
Vertical		5458.8	28.53	19.57	48.1	54	-5.9	AVG
	@	5700	73.65	19.73	93.38	N/A	N/A	PK
	@	5700	64.33	19.73	84.06	N/A	N/A	AVG
		5731.8	39.98	20.02	60	68.2	-8.2	PK
	*	11400	29.89	18.85	48.74	74	-25.26	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790224862-US-R1-V0
Page : 149 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

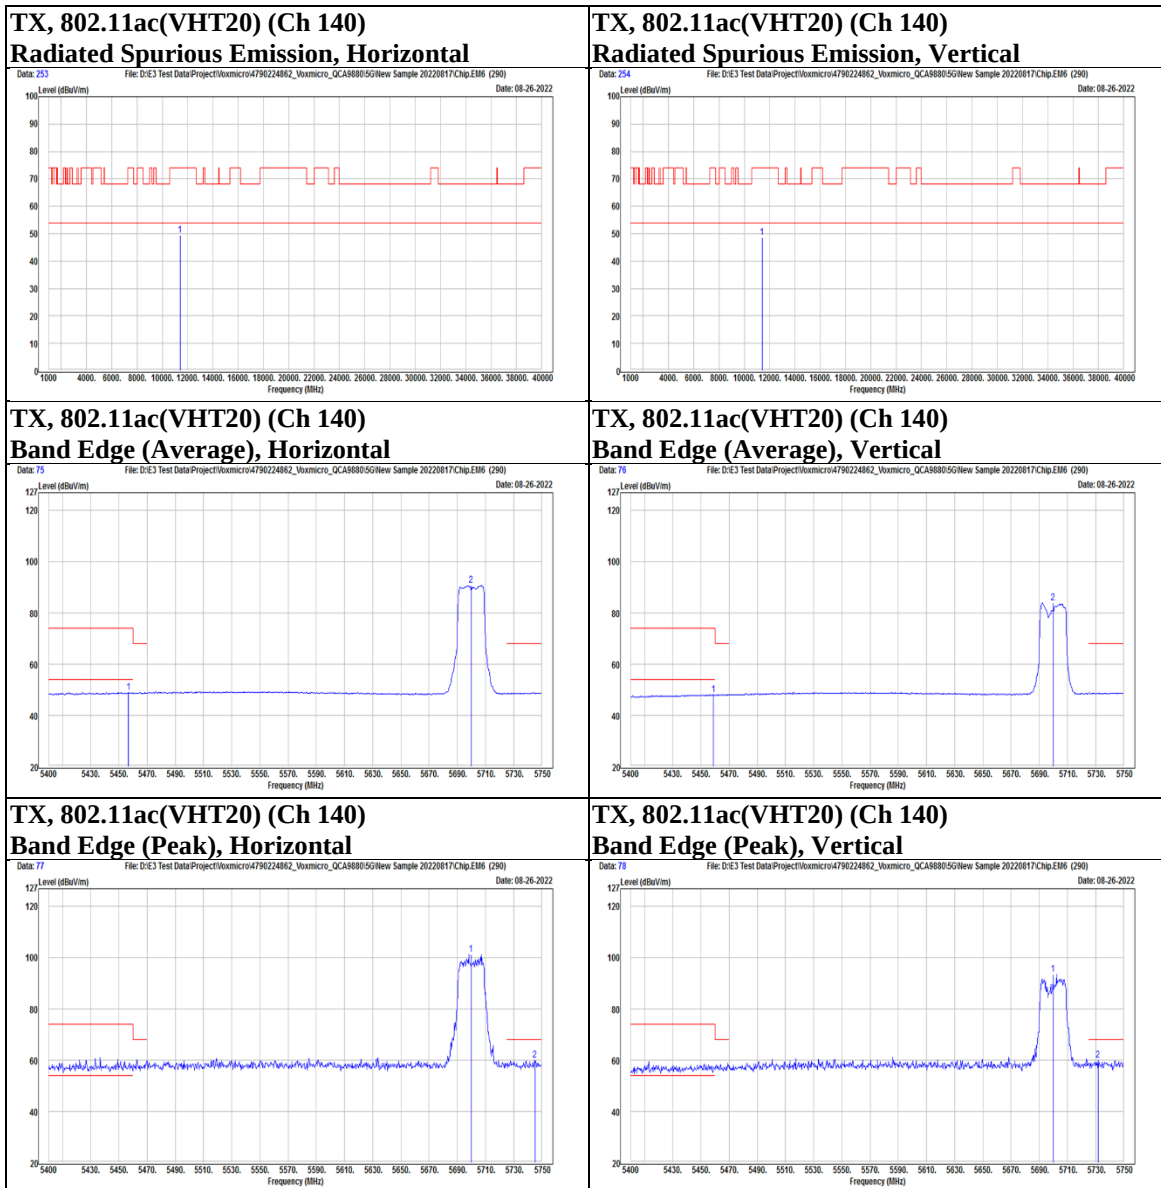

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948


Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790224862-US-R1-V0
Page : 150 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11ac(VHT20)	Channel	149
------	-----------------	---------	-----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		5557.5	44.08	19.81	63.89	68.2	-4.31	PK
		5700	40.66	19.73	60.39	105.2	-44.81	PK
	@	5745	89.68	20.15	109.83	N/A	N/A	PK
	*	11490	29.5	19.33	48.83	74	-25.17	PK
Vertical		5561.5	40.8	19.8	60.6	68.2	-7.6	PK
		5677	39.9	19.7	59.6	88.22	-28.62	PK
	@	5745	84.01	20.15	104.16	N/A	N/A	PK
	*	11490	29.31	19.33	48.64	74	-25.36	PK

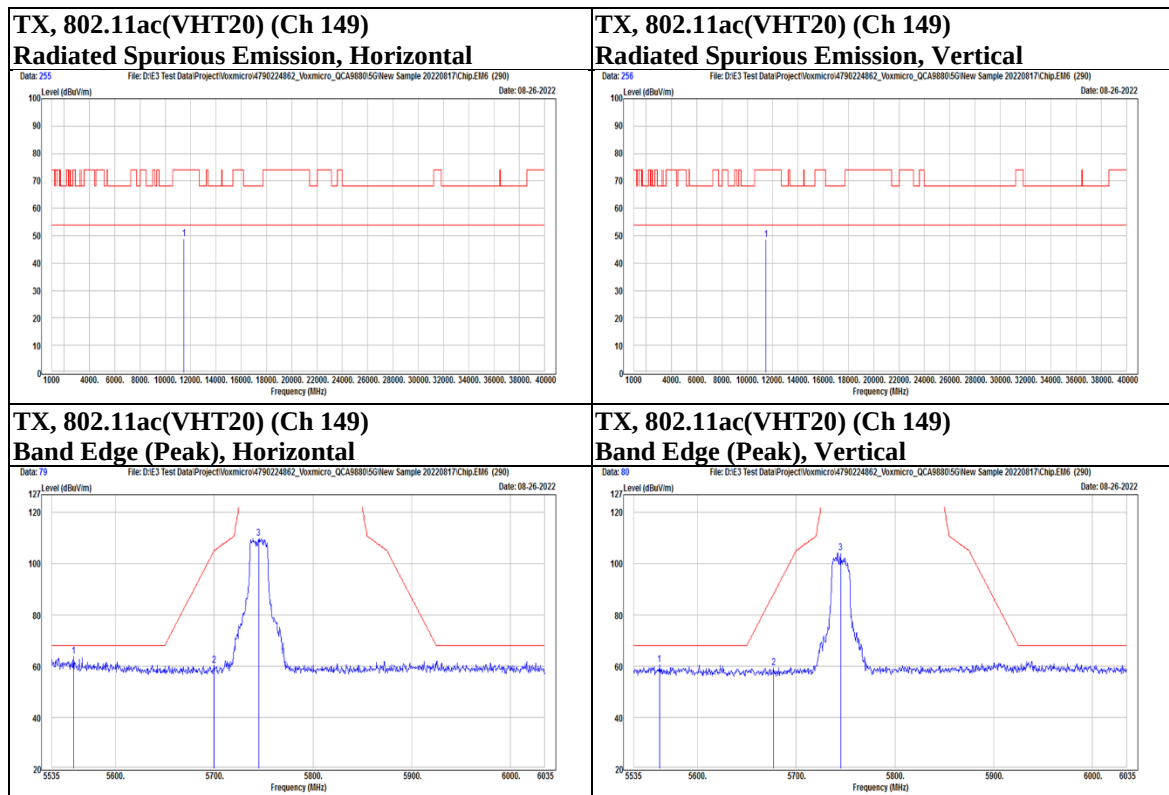

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0




Test report No. : 4790224862-US-R1-V0
Page : 151 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11ac(VHT20)	Channel	157
------	-----------------	---------	-----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		5543	42.93	19.82	62.75	68.2	-5.45	PK
		5687	40.84	19.71	60.55	95.61	-35.06	PK
	@	5785	88.36	20.45	108.81	N/A	N/A	PK
		5876.5	40.21	20.81	61.02	104.09	-43.07	PK
		5934.5	40.19	20.95	61.14	68.2	-7.06	PK
	*	11570	30.2	19.07	49.27	74	-24.73	PK
Vertical		5601.5	40.6	19.71	60.31	68.2	-7.89	PK
		5652.5	40.71	19.67	60.38	70.06	-9.68	PK
	@	5785	81.65	20.45	102.1	N/A	N/A	PK
		5902	40.22	20.98	61.2	85.18	-23.98	PK
		5929	40.57	20.95	61.52	68.2	-6.68	PK
	*	11570	29.48	19.07	48.55	74	-25.45	PK


TX, 802.11ac(VHT20) (Ch 157)

Radiated Spurious Emission, Horizontal

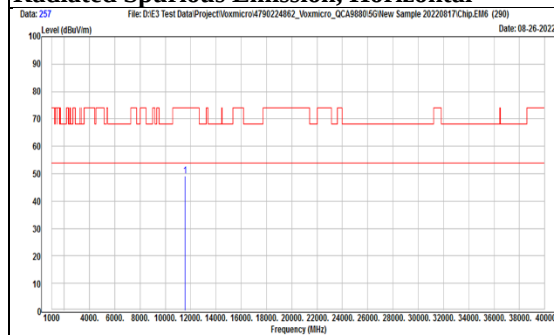


TX, 802.11ac(VHT20) (Ch 157)

Radiated Spurious Emission, Vertical

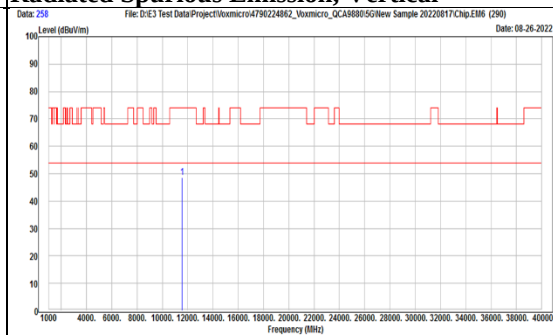


TX, 802.11ac(VHT20) (Ch 157)

Band Edge (Peak), Horizontal

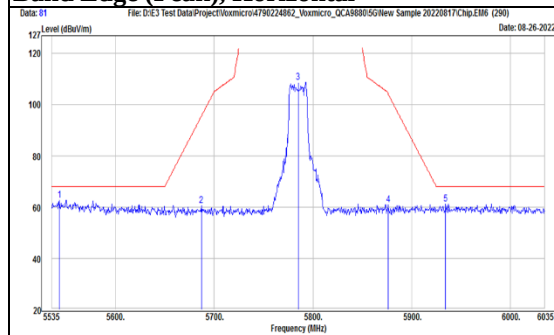

TX, 802.11ac(VHT20) (Ch 157)

Band Edge (Peak), Vertical

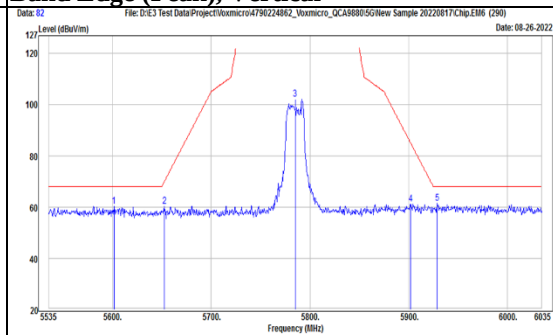

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948


Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790224862-US-R1-V0
Page : 152 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11ac(VHT20)	Channel	165
------	-----------------	---------	-----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal	@	5825	84.89	20.58	105.47	N/A	N/A	PK
		5895	41.68	20.94	62.62	90.36	-27.74	PK
		5932.5	40.89	20.96	61.85	68.2	-6.35	PK
	*	11650	30.07	18.83	48.9	74	-25.1	PK
Vertical	@	5825	78.02	20.58	98.6	N/A	N/A	PK
		5881	41.09	20.85	61.94	100.74	-38.8	PK
		5975.5	40.97	20.97	61.94	68.2	-6.26	PK
	*	11650	29.19	18.83	48.02	74	-25.98	PK

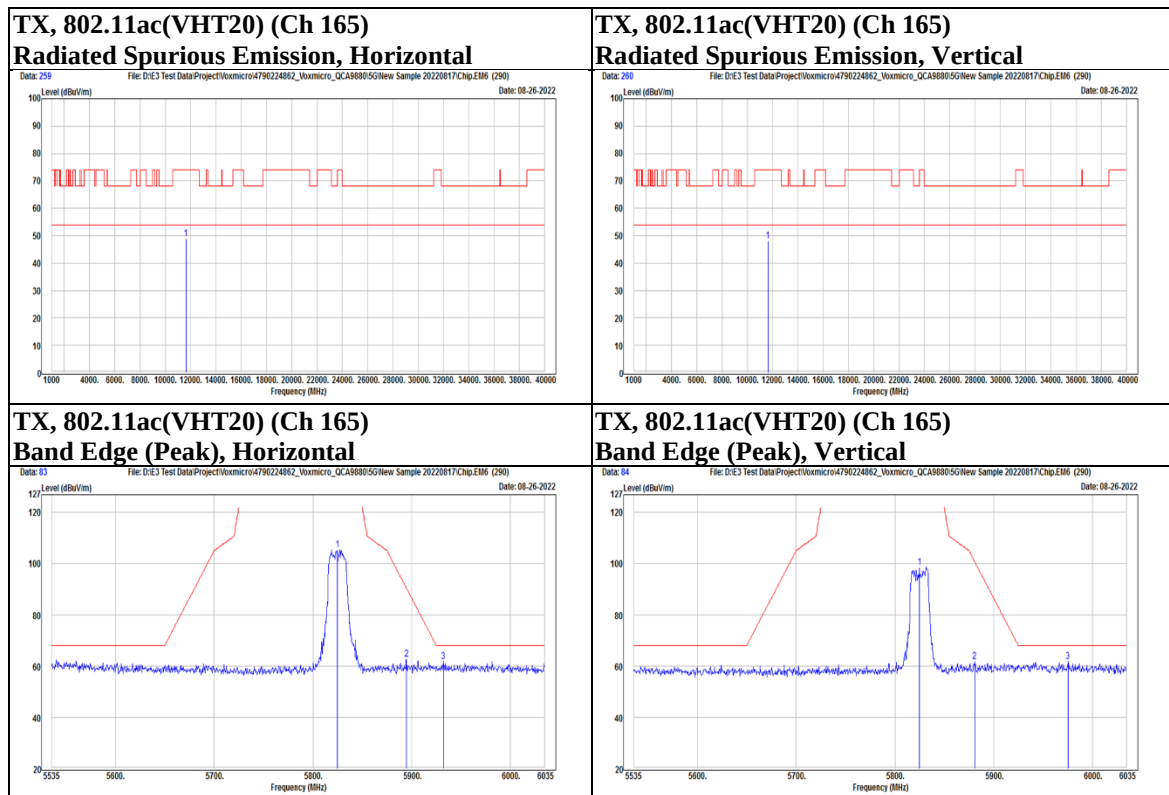

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790224862-US-R1-V0
Page : 153 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11ac(VHT40)	Channel	38
------	-----------------	---------	----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		5099.05	30.59	19.43	50.02	54	-3.98	AVG
		5114.8	41.88	19.43	61.31	74	-12.69	PK
	@	5190	83.49	19.29	102.78	N/A	N/A	PK
	@	5190	73.79	19.29	93.08	N/A	N/A	AVG
	*	10380	29.43	17.61	47.04	68.2	-21.16	PK
Vertical		5091.35	30.68	19.38	50.06	54	-3.94	AVG
		5115.15	43.05	19.43	62.48	74	-11.52	PK
	@	5190	72.66	19.29	91.95	N/A	N/A	PK
	@	5190	63.34	19.29	82.63	N/A	N/A	AVG
	*	10380	29.92	17.61	47.53	68.2	-20.67	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790224862-US-R1-V0
Page : 154 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

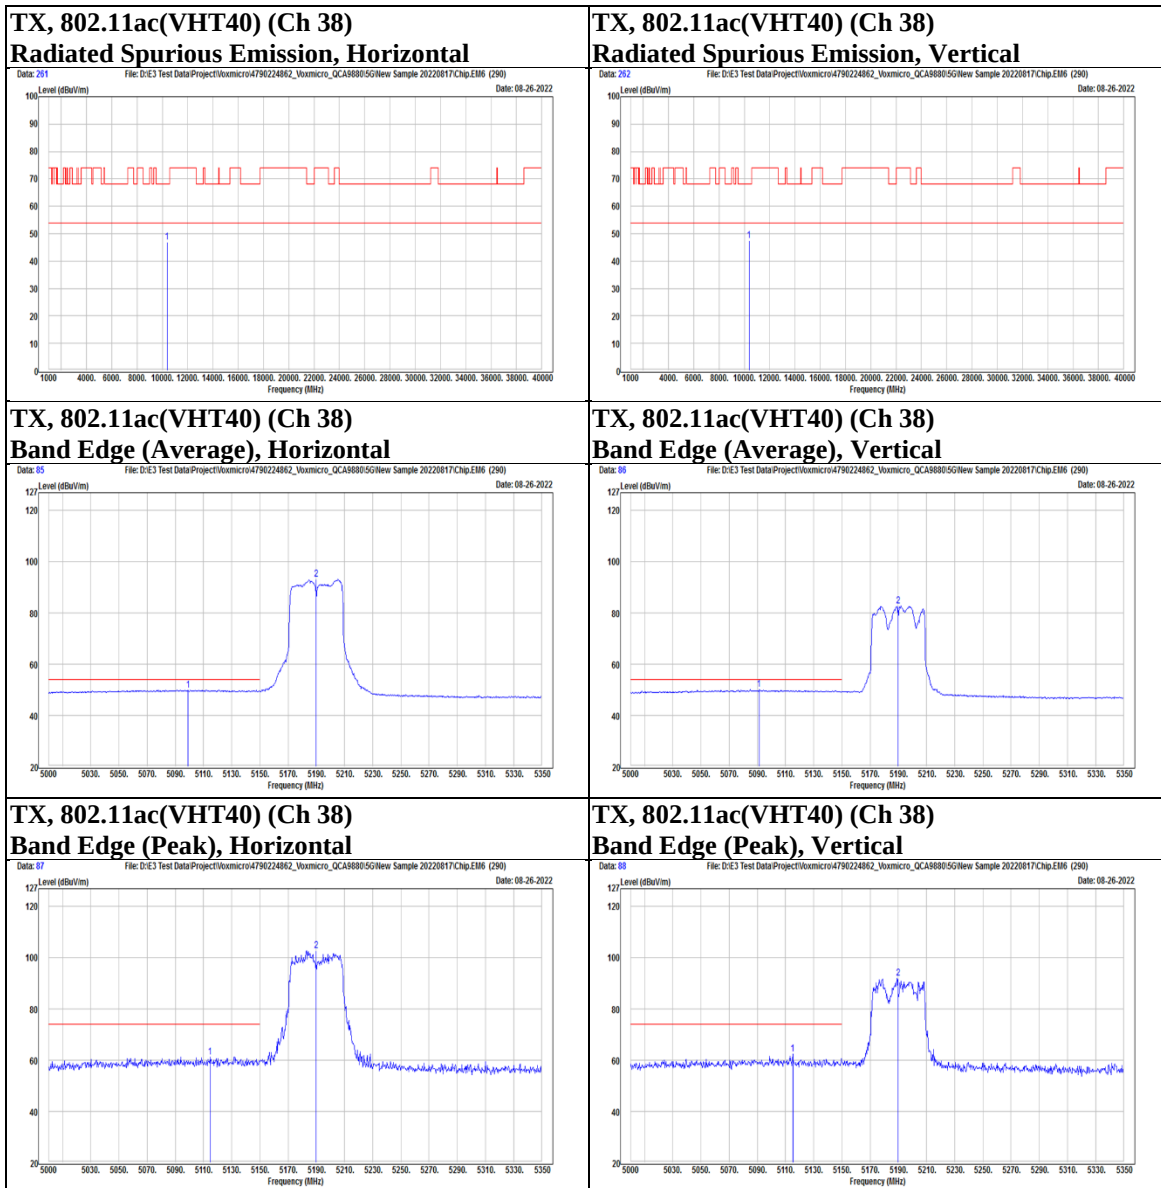

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790224862-US-R1-V0
Page : 155 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11ac(VHT40)	Channel	46
------	-----------------	---------	----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		5068.6	43.44	19.22	62.66	74	-11.34	PK
		5114.45	30.6	19.43	50.03	54	-3.97	AVG
	@	5230	89.8	19.05	108.85	N/A	N/A	PK
	@	5230	78.74	19.05	97.79	N/A	N/A	AVG
	*	10460	29.47	17.87	47.34	68.2	-20.86	PK
Vertical		5084	42.67	19.33	62	74	-12	PK
		5098	30.75	19.43	50.18	54	-3.82	AVG
	@	5230	80.12	19.05	99.17	N/A	N/A	PK
	@	5230	70.76	19.05	89.81	N/A	N/A	AVG
	*	10460	30.22	17.87	48.09	68.2	-20.11	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790224862-US-R1-V0
Page : 156 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

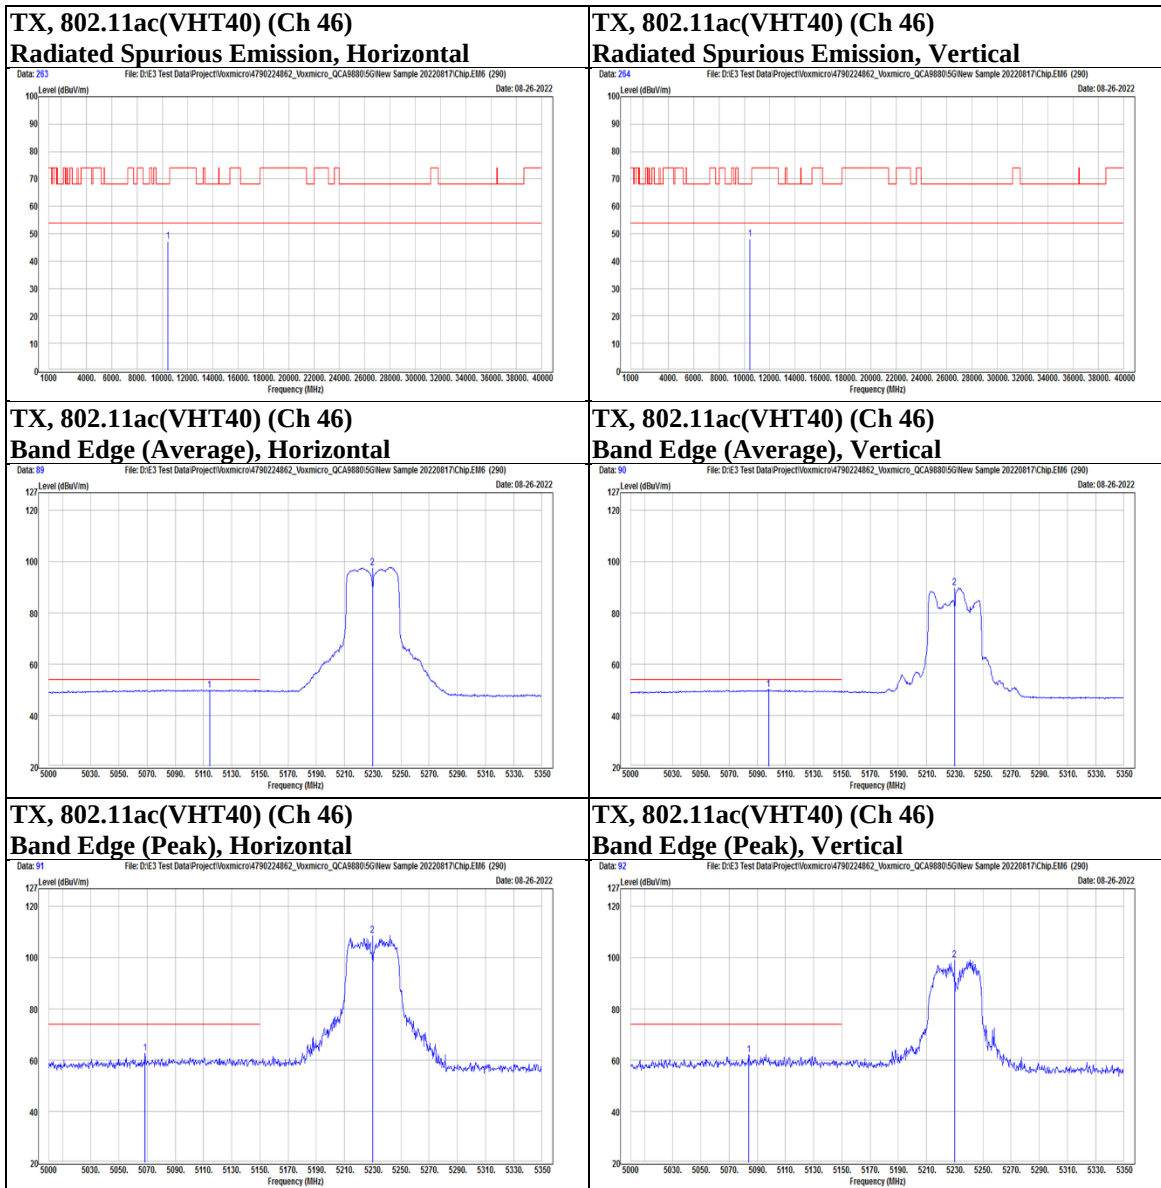

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790224862-US-R1-V0
Page : 157 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11ac(VHT40)	Channel	54
------	-----------------	---------	----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal	@	5270	89.4	18.85	108.25	N/A	N/A	PK
	@	5270	78.98	18.85	97.83	N/A	N/A	AVG
		5369.4	40.48	19.12	59.6	74	-14.4	PK
		5448	29.19	19.5	48.69	54	-5.31	AVG
	*	10540	29.61	18.01	47.62	68.2	-20.58	PK
Vertical	@	5270	79.97	18.85	98.82	N/A	N/A	PK
	@	5270	70.11	18.85	88.96	N/A	N/A	AVG
		5442	40.78	19.48	60.26	74	-13.74	PK
		5459.7	28.74	19.57	48.31	54	-5.69	AVG
	*	10540	29.75	18.01	47.76	68.2	-20.44	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790224862-US-R1-V0
Page : 158 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

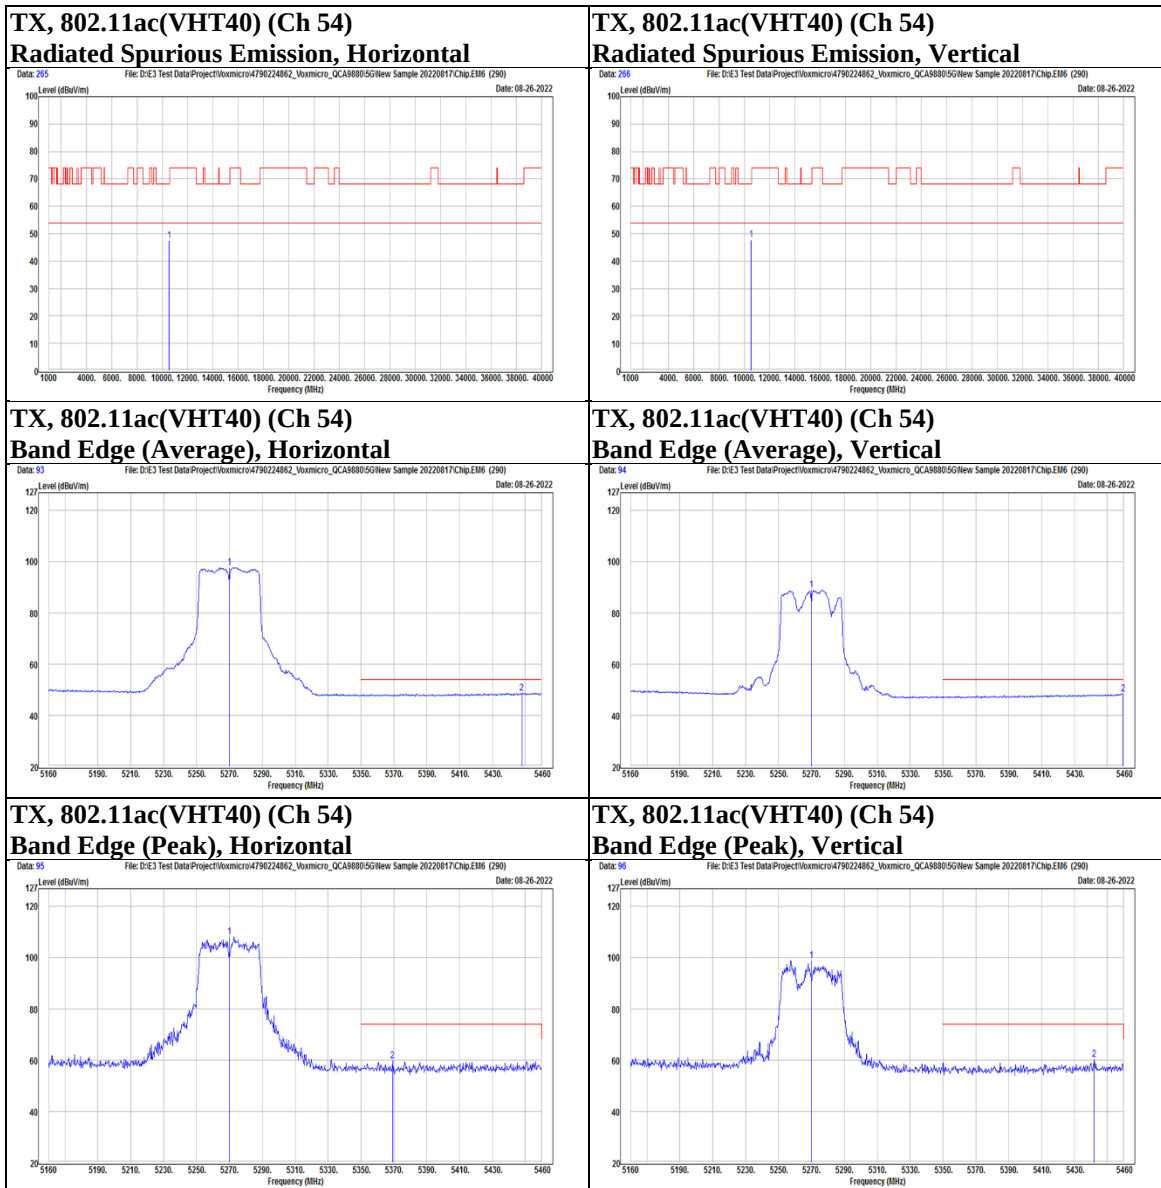

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790224862-US-R1-V0
Page : 159 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11ac(VHT40)	Channel	62
------	-----------------	---------	----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal	@	5310	85.25	18.81	104.06	N/A	N/A	PK
	@	5310	75.18	18.81	93.99	N/A	N/A	AVG
		5350.5	29.49	19.01	48.5	54	-5.5	AVG
		5379.3	40.96	19.16	60.12	74	-13.88	PK
	*	10620	29.3	18.04	47.34	74	-26.66	PK
Vertical	@	5310	75.04	18.81	93.85	N/A	N/A	PK
	@	5310	66.09	18.81	84.9	N/A	N/A	AVG
		5442.9	40.57	19.49	60.06	74	-13.94	PK
		5454	28.62	19.54	48.16	54	-5.84	AVG
	*	10620	29.37	18.04	47.41	74	-26.59	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790224862-US-R1-V0
Page : 160 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

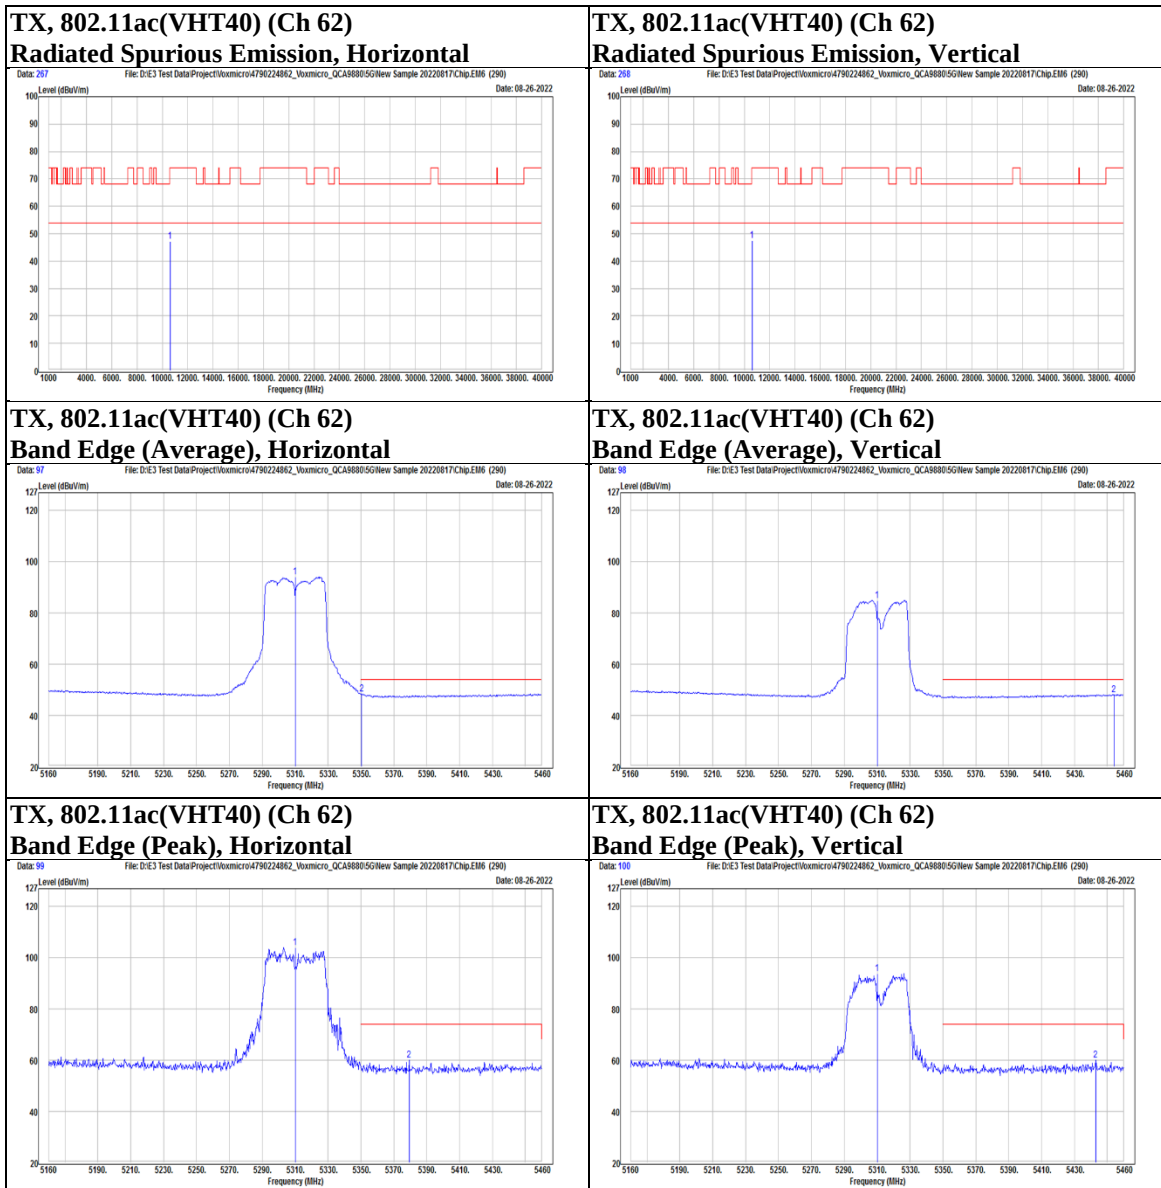

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790224862-US-R1-V0
Page : 161 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11ac(VHT40)	Channel	102
------	-----------------	---------	-----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		5445.85	40.12	19.5	59.62	74	-14.38	PK
		5450.75	29.55	19.52	49.07	54	-4.93	AVG
		5468.95	40.47	19.62	60.09	68.2	-8.11	PK
	@	5510	84.28	19.78	104.06	N/A	N/A	PK
	@	5510	74.49	19.78	94.27	N/A	N/A	AVG
	*	11020	30.95	18.42	49.37	74	-24.63	PK
Vertical		5450.05	41.69	19.51	61.2	74	-12.8	PK
		5457.05	28.75	19.55	48.3	54	-5.7	AVG
		5464.75	38.86	19.59	58.45	68.2	-9.75	PK
	@	5510	77.82	19.78	97.6	N/A	N/A	PK
	@	5510	68.51	19.78	88.29	N/A	N/A	AVG
	*	11020	29.67	18.42	48.09	74	-25.91	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan


Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790224862-US-R1-V0
Page : 162 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

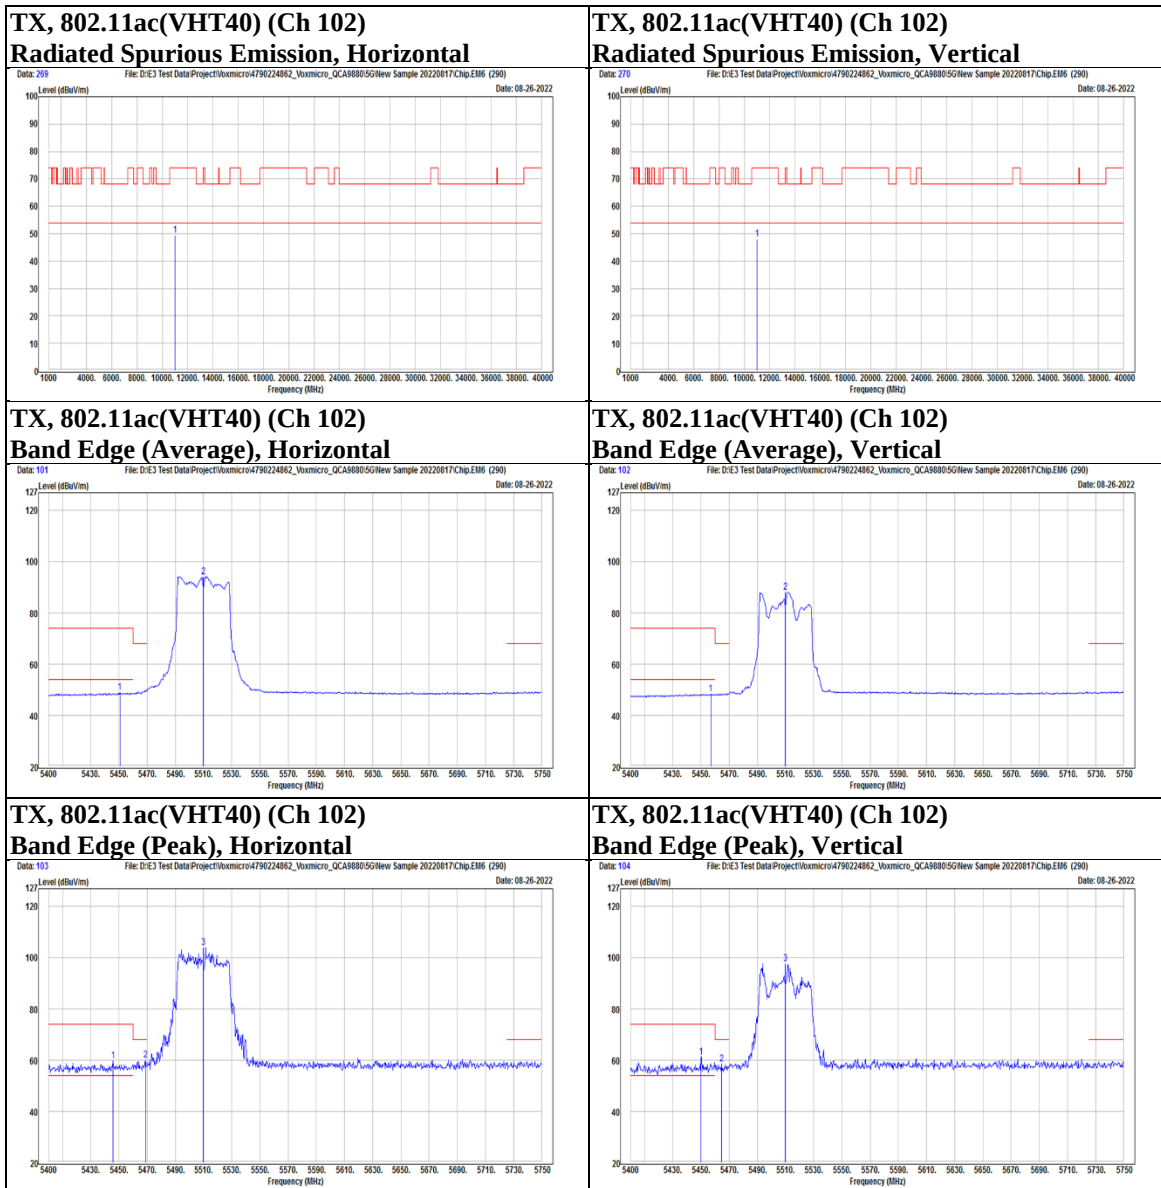

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone : +886-2-7737-3000

Facsimile (FAX) : +886-3-583-7948

Doc No: 17-EM-F0878 / 6.0



Test report No. : 4790224862-US-R1-V0
Page : 163 of 387
Issued date : 2022/9/30
FCC ID : 2AE3B-AEX-QCA98X

Mode	802.11ac(VHT40)	Channel	110
------	-----------------	---------	-----

Polarization	Notation	Frequency (MHz)	Reading (dBuV)	Correct (dB/m)	Result (dBuV/m)	Limit (dBuV/m)	Margin (dB)	Remark
Horizontal		5453.55	29.32	19.53	48.85	54	-5.15	AVG
		5456	40.24	19.54	59.78	74	-14.22	PK
		5462.3	40.39	19.58	59.97	68.2	-8.23	PK
	@	5550	83.9	19.83	103.73	N/A	N/A	PK
	@	5550	75.03	19.83	94.86	N/A	N/A	AVG
		5744.05	40.39	20.14	60.53	68.2	-7.67	PK
	*	11100	29.94	18.45	48.39	74	-25.61	PK
Vertical		5451.45	28.72	19.53	48.25	54	-5.75	AVG
		5453.2	39.56	19.53	59.09	74	-14.91	PK
		5469.65	38.53	19.62	58.15	68.2	-10.05	PK
	@	5550	76.67	19.83	96.5	N/A	N/A	PK
	@	5550	67.62	19.83	87.45	N/A	N/A	AVG
		5733.55	40.86	20.04	60.9	68.2	-7.3	PK
	*	11100	30.41	18.45	48.86	74	-25.14	PK

Underwriters Laboratories Taiwan Co., Ltd.

Building B and Building E, No. 372-7, Sec. 4, Zhongxing Rd., Zhudong Township, Hsinchu County, Taiwan

Telephone :+886-2-7737-3000

Facsimile (FAX) :+886-3-583-7948

Doc No: 17-EM-F0878 / 6.0