



Shenzhen GUOREN Certification Technology Service Co., Ltd.

101#, Building K & Building T, The Second Industrial Zone, Jiazitang Community,
Fenghuang Street, Guangming District, Shenzhen, China

No.:GRCTR250902006-03

FCC ID:2AEIXZJMT95L

Band4	5MHz	16QAM	20375	1RB#0	-52.51	PASS
Band4	5MHz	16QAM	20375	1RB#24	-23.37	PASS
Band4	5MHz	16QAM	20375	25RB#0	-35.46	PASS
Band4	10MHz	QPSK	20000	1RB#0	-29.35	PASS
Band4	10MHz	QPSK	20000	1RB#49	-49.44	PASS
Band4	10MHz	QPSK	20000	50RB#0	-37.53	PASS
Band4	10MHz	16QAM	20000	1RB#0	-30.23	PASS
Band4	10MHz	16QAM	20000	1RB#49	-49.82	PASS
Band4	10MHz	QPSK	20350	1RB#0	-49.57	PASS
Band4	10MHz	QPSK	20350	1RB#49	-28.34	PASS
Band4	10MHz	QPSK	20350	50RB#0	-35.24	PASS
Band4	10MHz	16QAM	20350	1RB#0	-50.23	PASS
Band4	10MHz	16QAM	20350	1RB#49	-30.05	PASS
Band4	15MHz	QPSK	20025	1RB#0	-35.32	PASS
Band4	15MHz	QPSK	20025	1RB#74	-47.97	PASS
Band4	15MHz	QPSK	20025	75RB#0	-35.77	PASS
Band4	15MHz	16QAM	20025	1RB#0	-36.23	PASS
Band4	15MHz	16QAM	20025	1RB#74	-47.98	PASS
Band4	15MHz	QPSK	20325	1RB#0	-47.74	PASS
Band4	15MHz	QPSK	20325	1RB#74	-34.30	PASS
Band4	15MHz	QPSK	20325	75RB#0	-33.11	PASS
Band4	15MHz	16QAM	20325	1RB#0	-48.26	PASS
Band4	15MHz	16QAM	20325	1RB#74	-35.28	PASS
Band4	20MHz	QPSK	20050	1RB#0	-39.27	PASS
Band4	20MHz	QPSK	20050	1RB#99	-46.89	PASS
Band4	20MHz	QPSK	20050	100RB#0	-35.96	PASS
Band4	20MHz	16QAM	20050	1RB#0	-39.76	PASS
Band4	20MHz	16QAM	20050	1RB#99	-47.46	PASS
Band4	20MHz	QPSK	20300	1RB#0	-46.93	PASS
Band4	20MHz	QPSK	20300	1RB#99	-38.50	PASS
Band4	20MHz	QPSK	20300	100RB#0	-34.03	PASS
Band4	20MHz	16QAM	20300	1RB#0	-46.94	PASS
Band4	20MHz	16QAM	20300	1RB#99	-39.52	PASS




Shenzhen GUOREN Certification Technology Service Co., Ltd.

101#, Building K & Building T, The Second Industrial Zone, Jiazitang Community,
Fenghuang Street, Guangming District, Shenzhen, China

No.:GRCTR250902006-03

FCC ID:2AEIXZJMT95L

Test Graphs

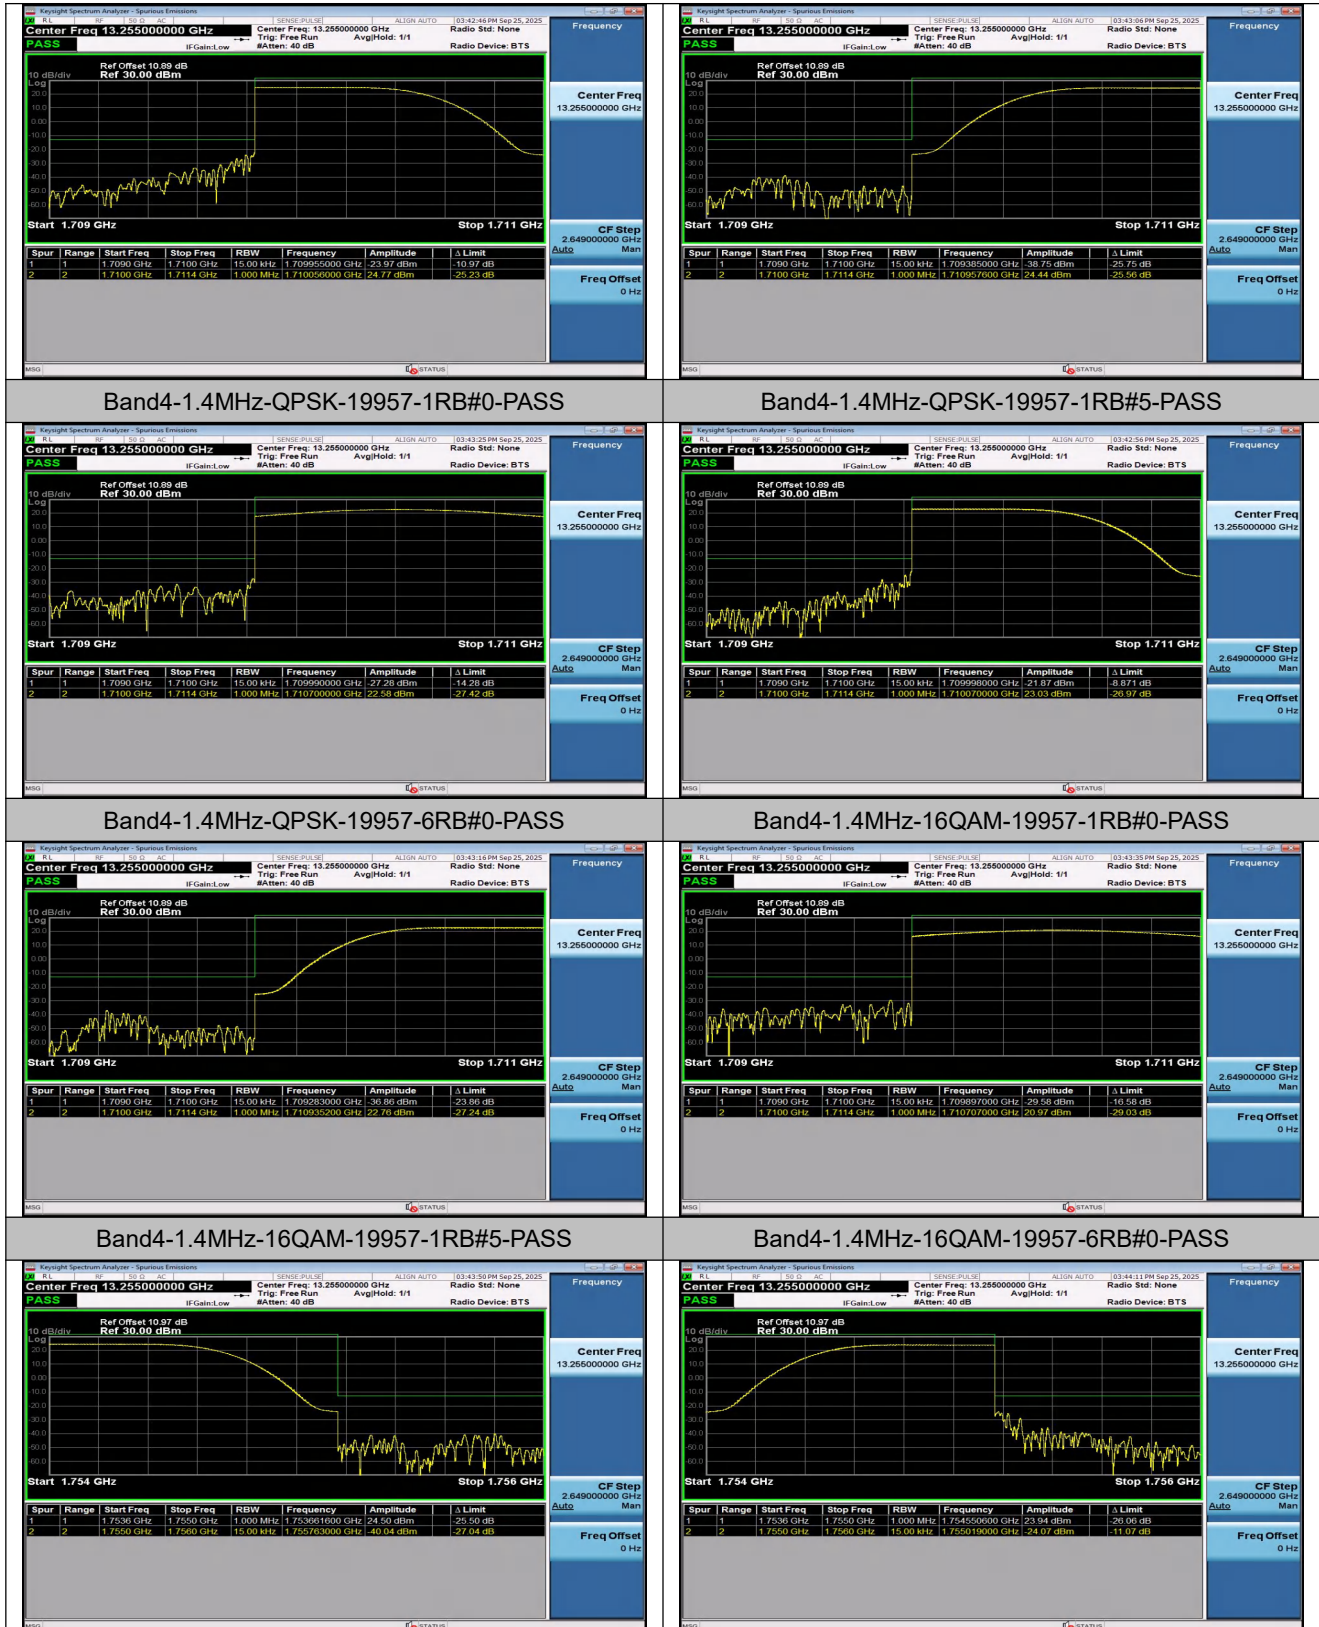




Shenzhen GUOREN Certification Technology Service Co., Ltd.

101#, Building K & Building T, The Second Industrial Zone, Jiazitang Community,
Fenghuang Street, Guangming District, Shenzhen, China

No.:GRCTR250902006-03

FCC ID:2AEIXZJMT95L

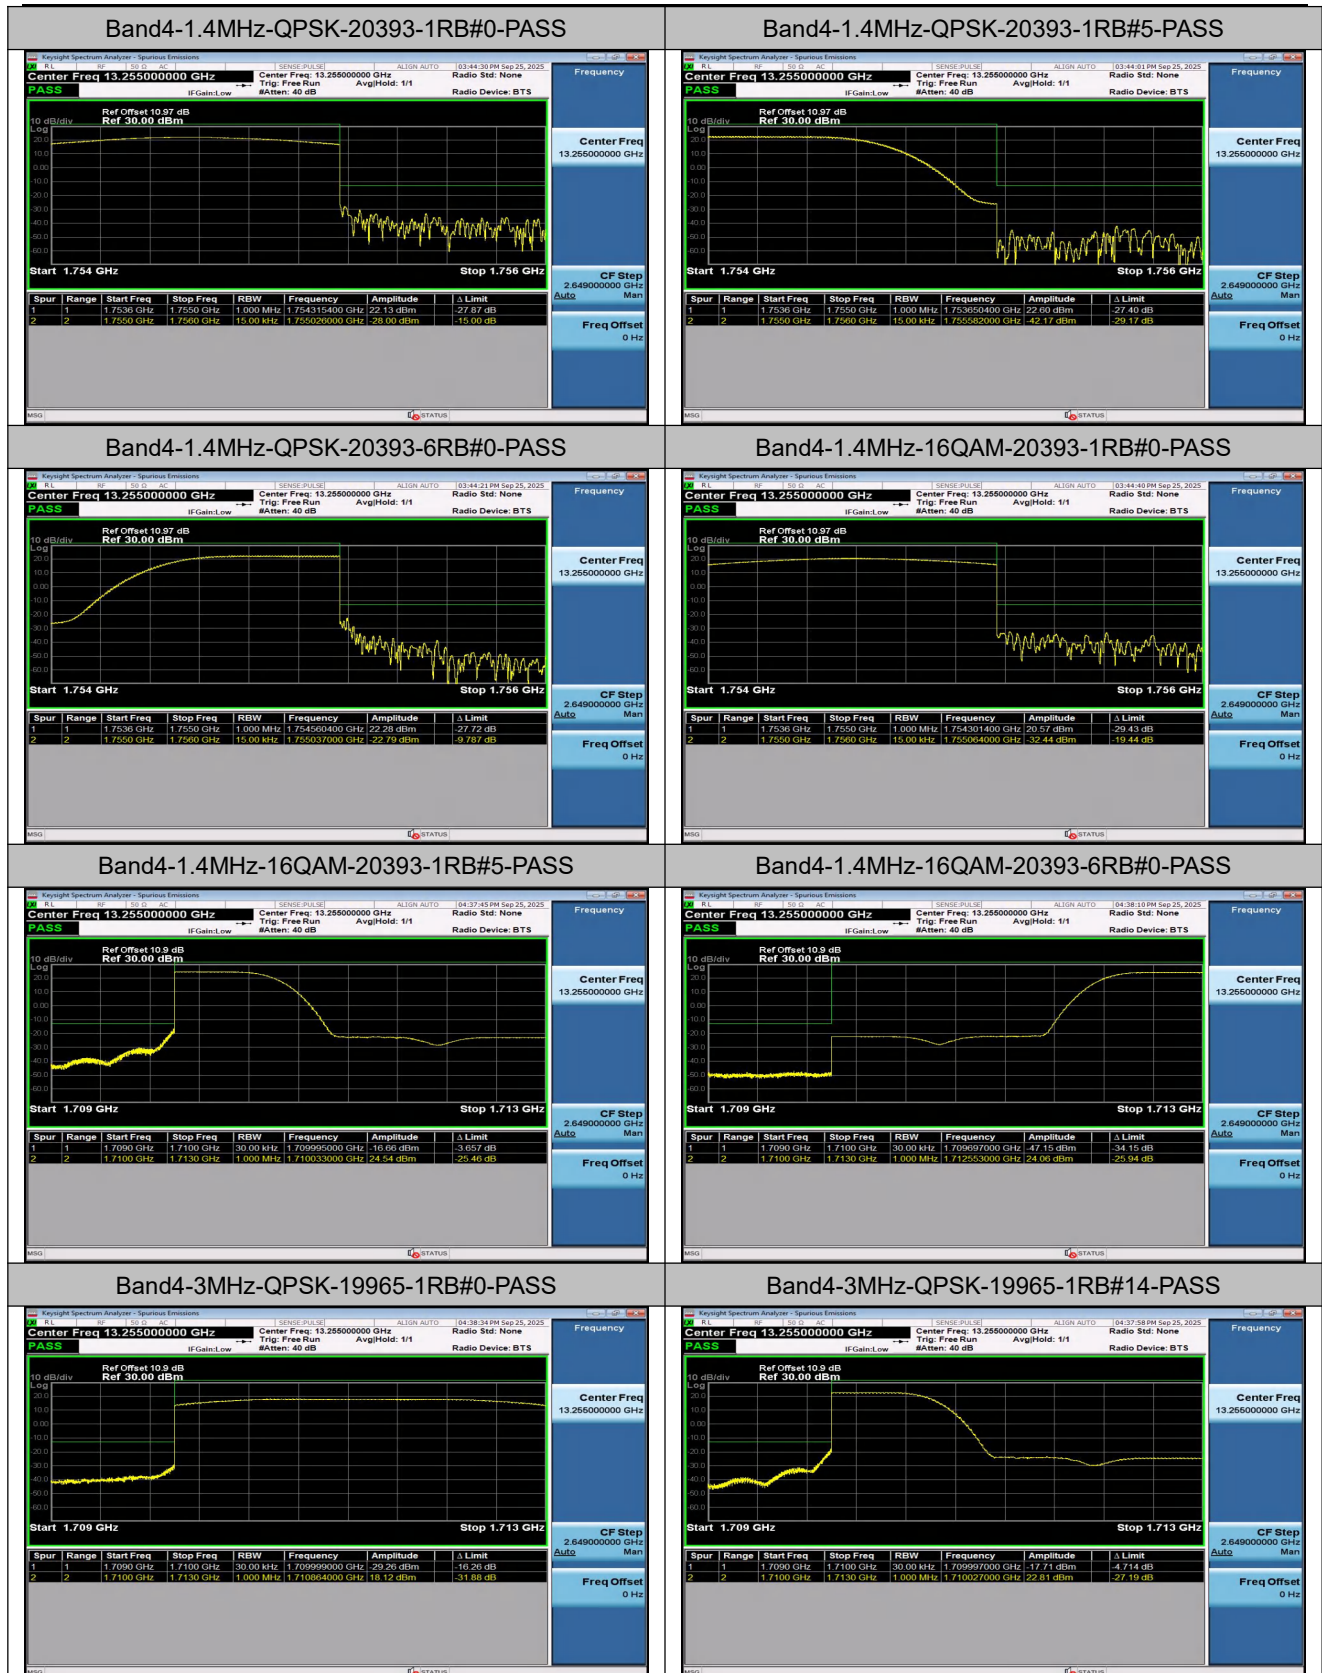




Shenzhen GUOREN Certification Technology Service Co., Ltd.

101#, Building K & Building T, The Second Industrial Zone, Jiazitang Community,
Fenghuang Street, Guangming District, Shenzhen, China

No.:GRCTR250902006-03

FCC ID:2AEIXZJMT95L

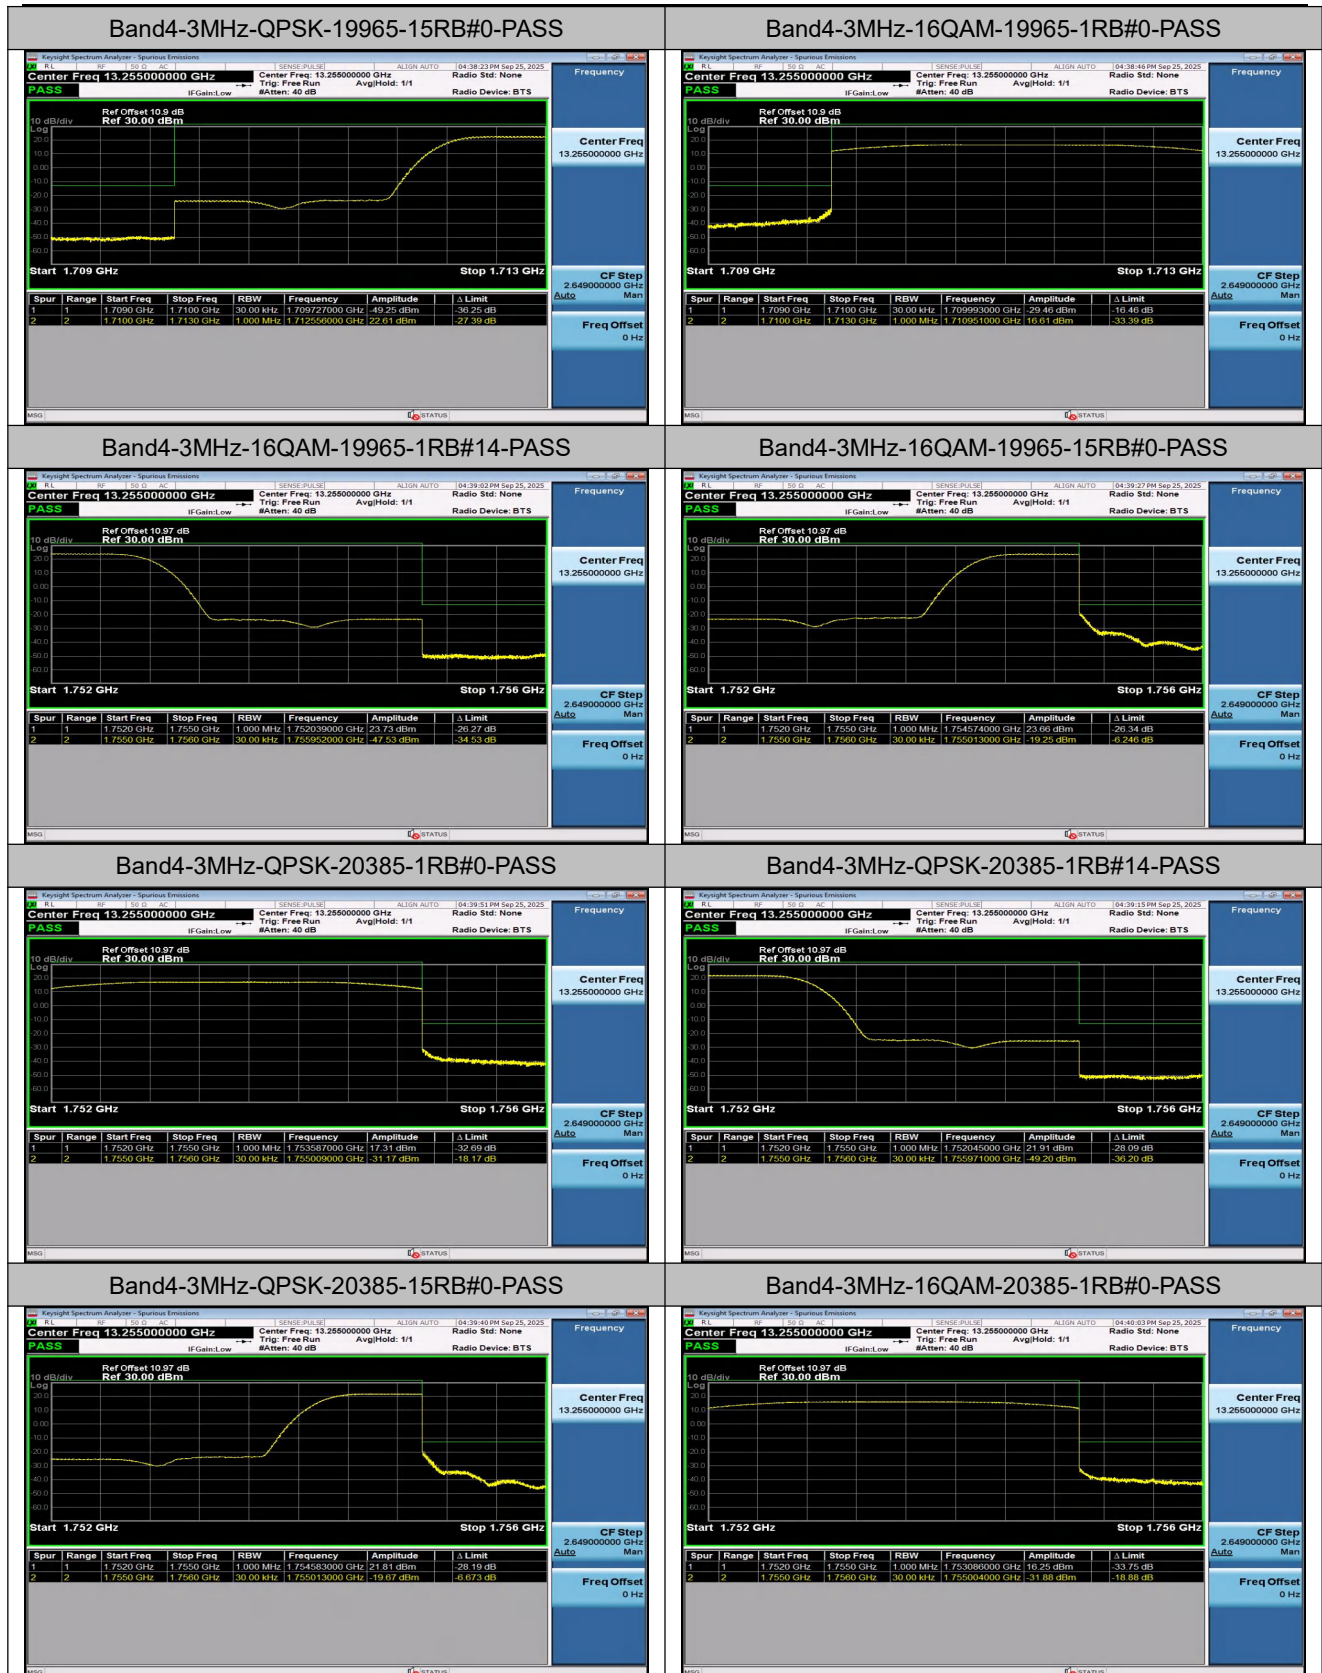




Shenzhen GUOREN Certification Technology Service Co., Ltd.

101#, Building K & Building T, The Second Industrial Zone, Jiazitang Community,
Fenghuang Street, Guangming District, Shenzhen, China

No.:GRCTR250902006-03

FCC ID:2AEIXZJMT95L

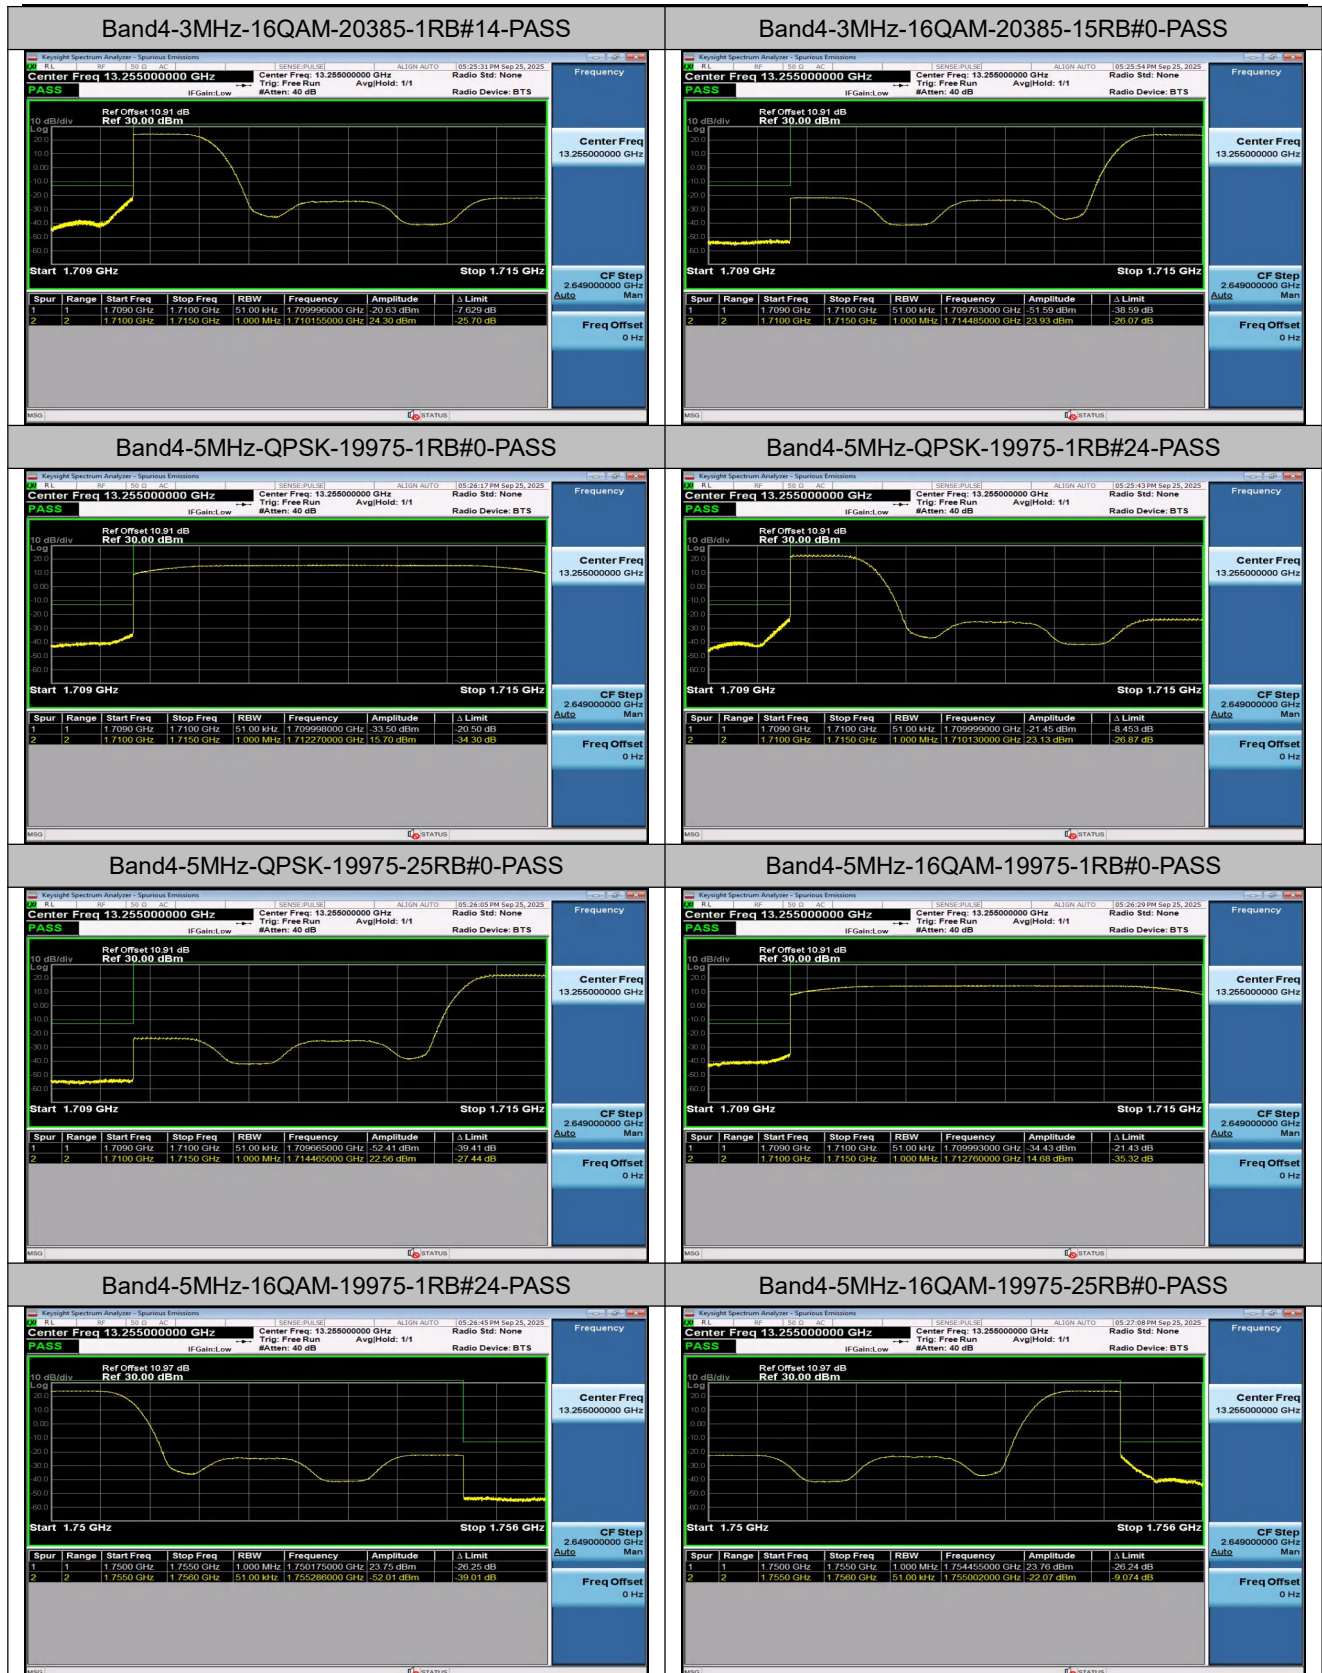




Shenzhen GUOREN Certification Technology Service Co., Ltd.

101#, Building K & Building T, The Second Industrial Zone, Jiazitang Community,
Fenghuang Street, Guangming District, Shenzhen, China

No.:GRCTR250902006-03

FCC ID:2AEIXZJMT95L

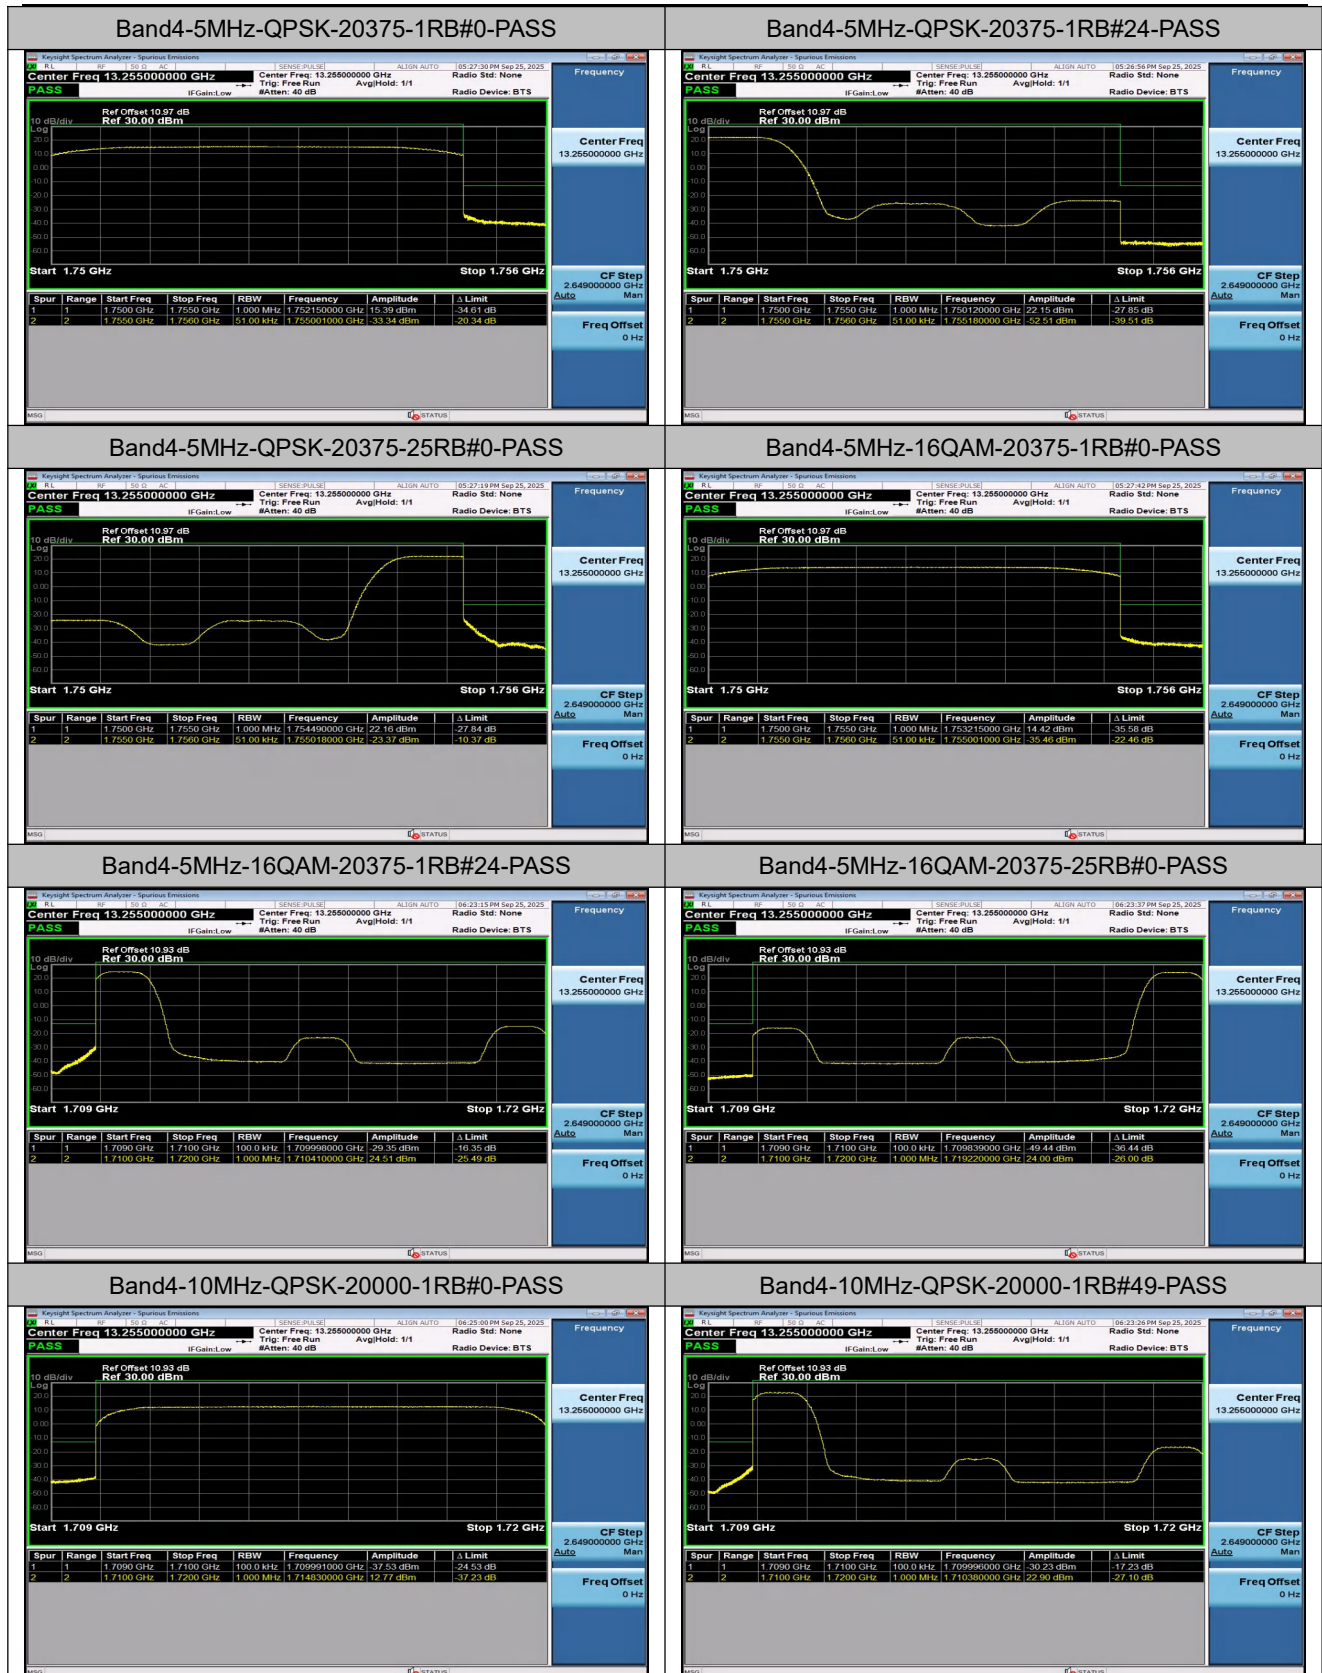




Shenzhen GUOREN Certification Technology Service Co., Ltd.

101#, Building K & Building T, The Second Industrial Zone, Jiazitang Community,
Fenghuang Street, Guangming District, Shenzhen, China

No.:GRCTR250902006-03

FCC ID:2AEIXZJMT95L

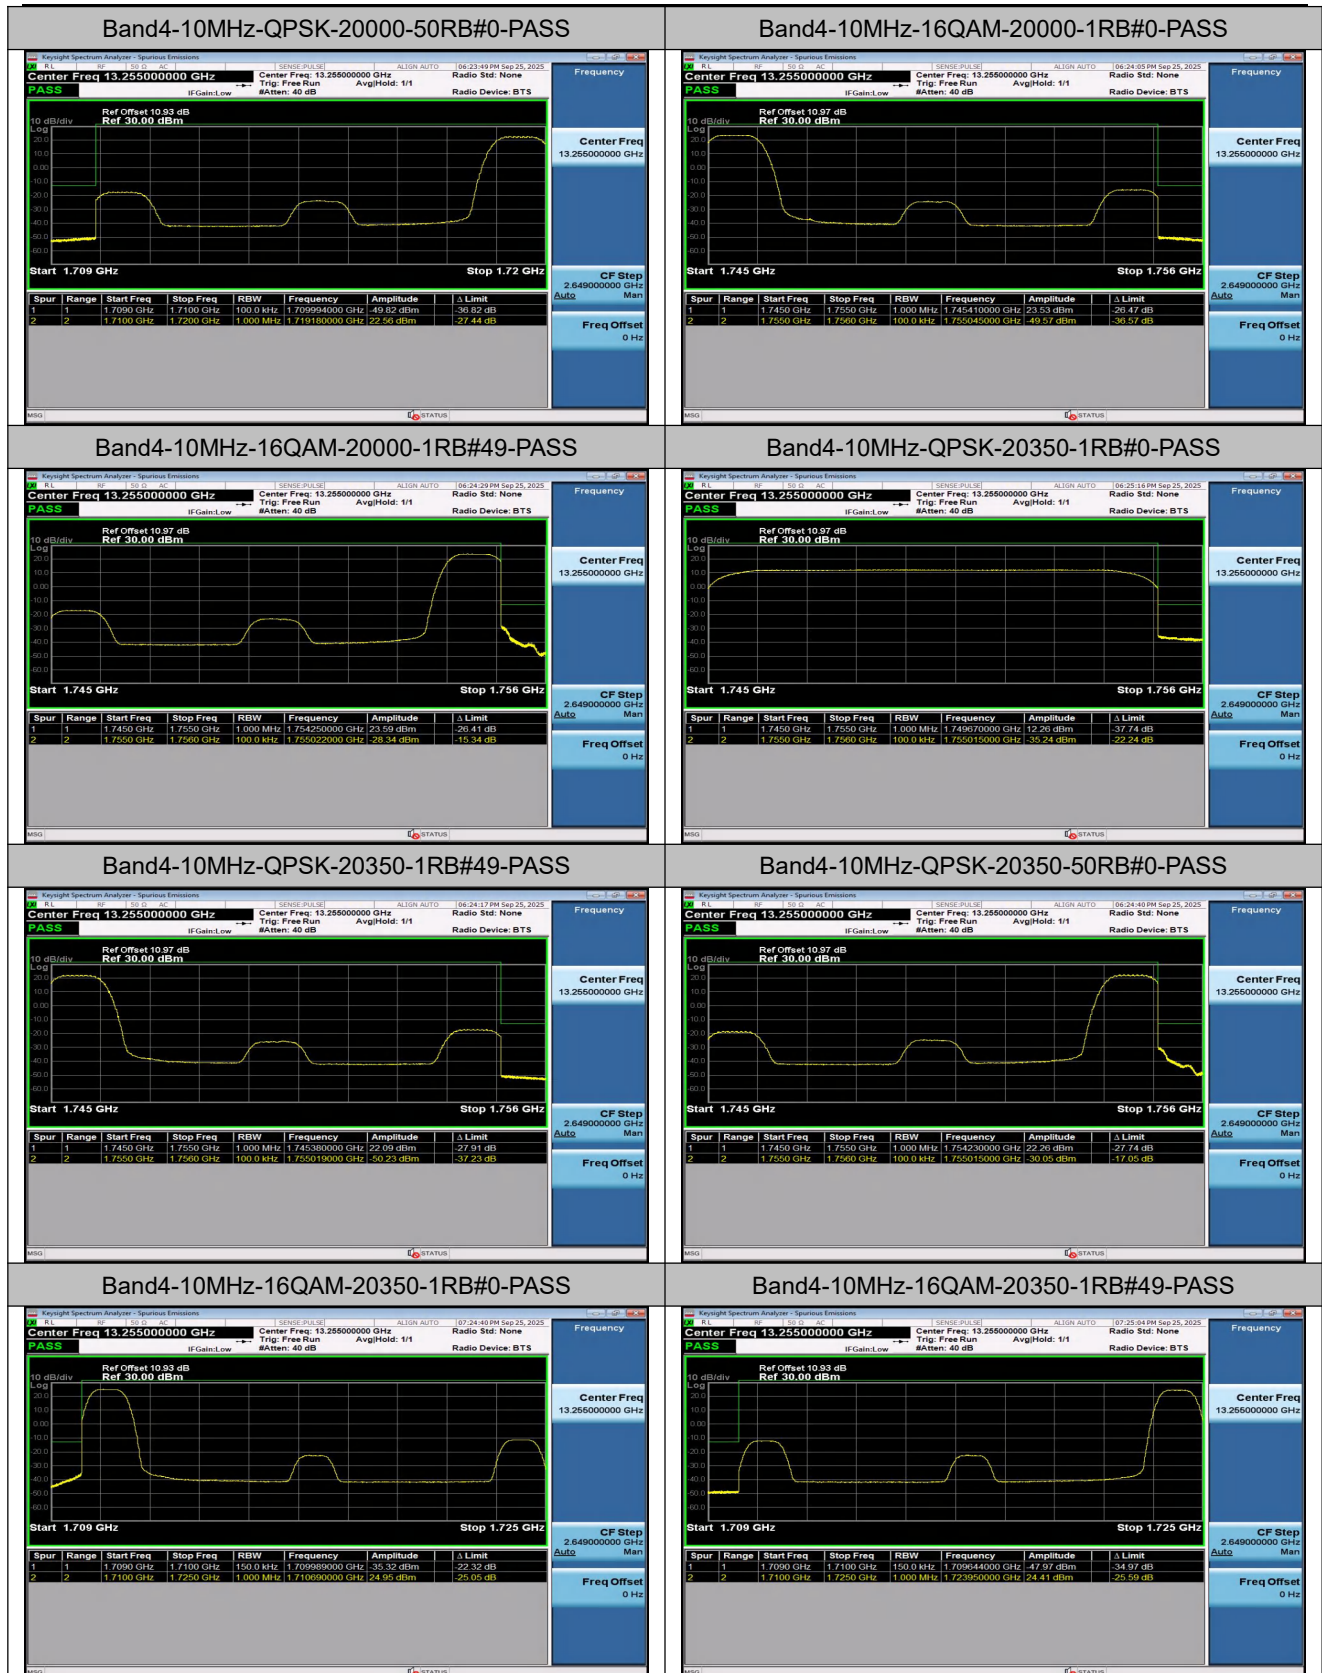




Shenzhen GUOREN Certification Technology Service Co., Ltd.

101#, Building K & Building T, The Second Industrial Zone, Jiazitang Community,
Fenghuang Street, Guangming District, Shenzhen, China

No.:GRCTR250902006-03

FCC ID:2AEIXZJMT95L

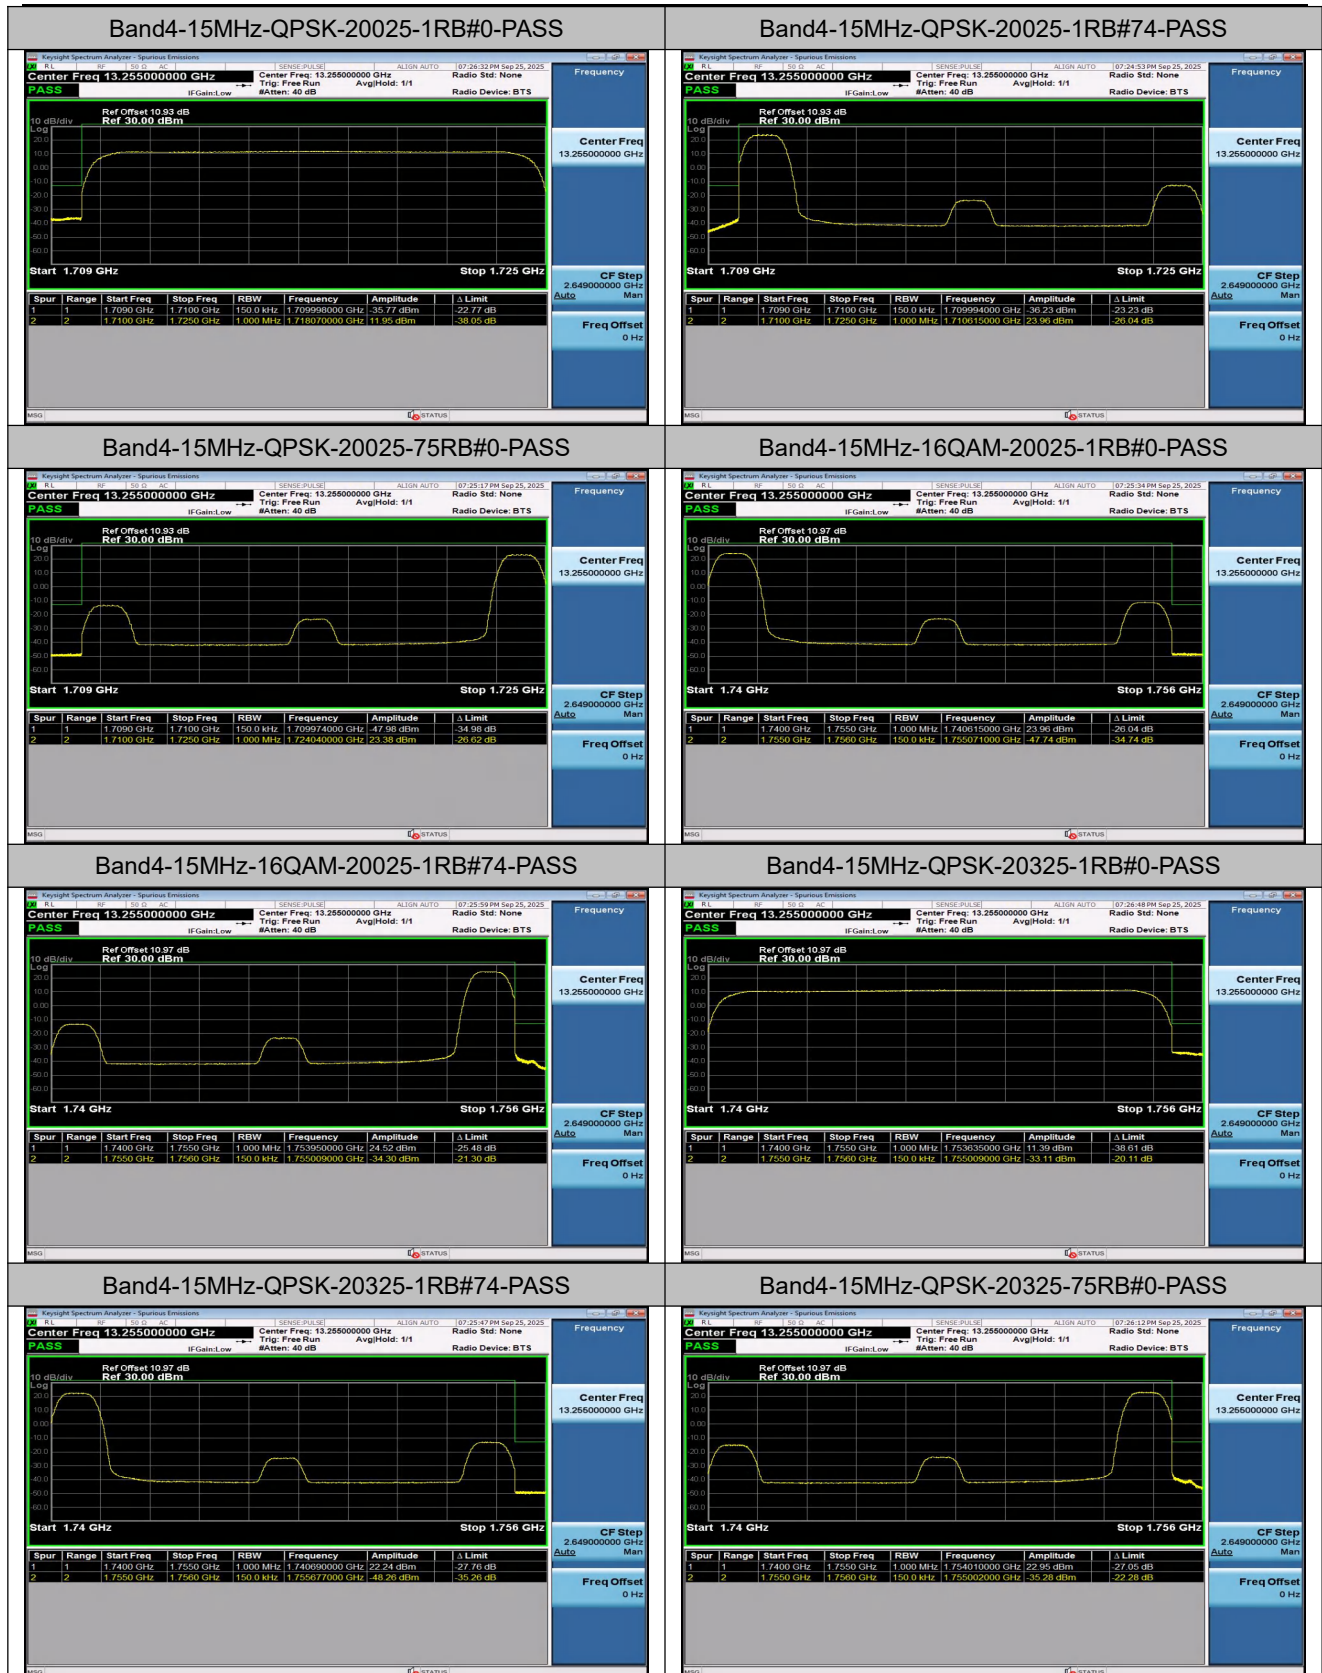




Shenzhen GUOREN Certification Technology Service Co., Ltd.

101#, Building K & Building T, The Second Industrial Zone, Jiazitang Community,
Fenghuang Street, Guangming District, Shenzhen, China


No.:GRCTR250902006-03

FCC ID:2AEIXZJMT95L

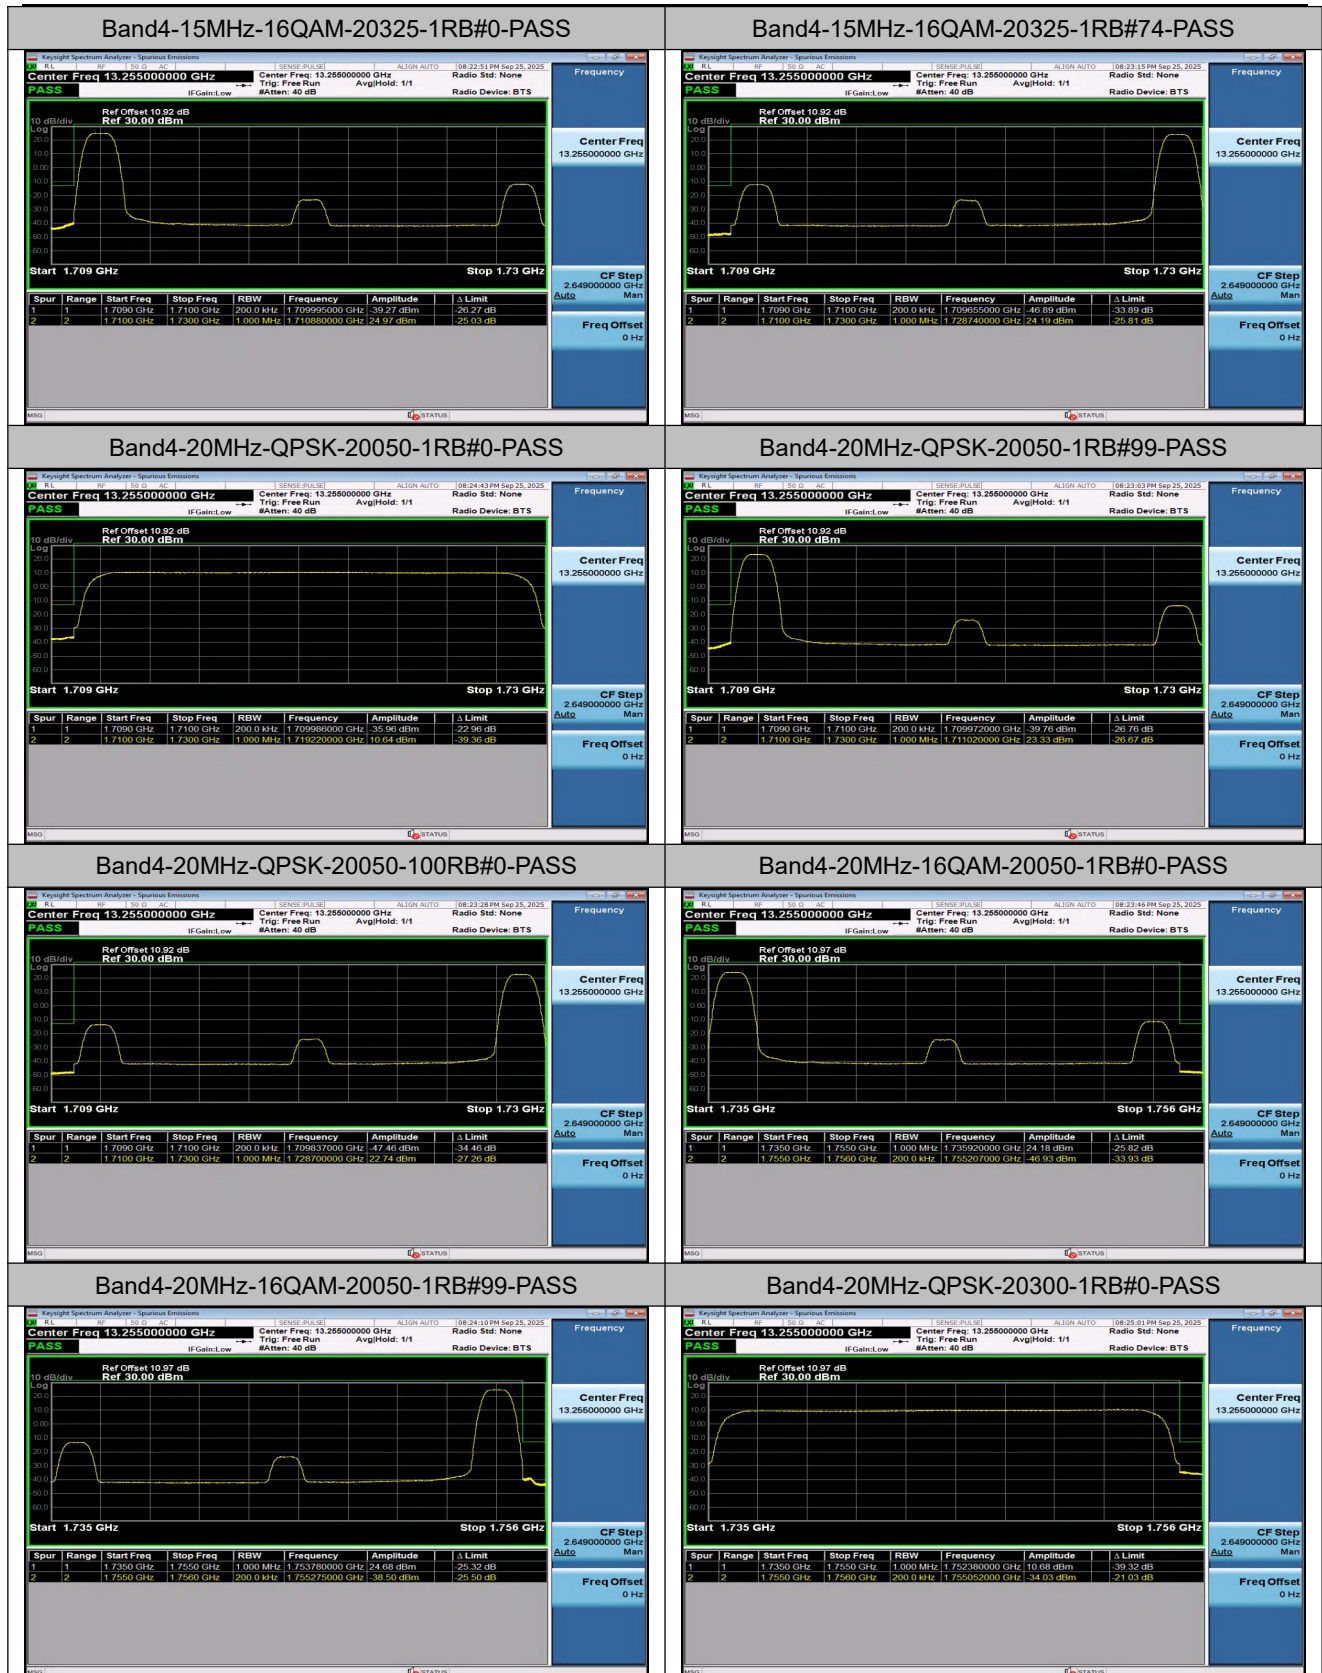

No.:GRCTR250902006-03

FCC ID:2AEIXZJMT95L

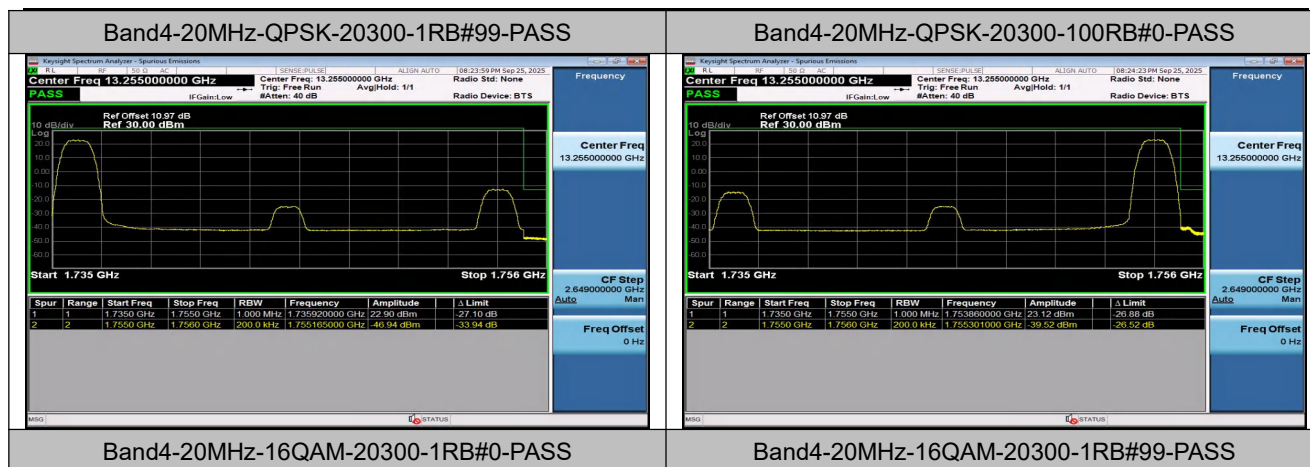



Shenzhen GUOREN Certification Technology Service Co., Ltd.

101#, Building K & Building T, The Second Industrial Zone, Jiazitang Community,
Fenghuang Street, Guangming District, Shenzhen, China

No.:GRCTR250902006-03

FCC ID:2AEIXZJMT95L

Appendix E: Conducted Spurious Emission

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Frequency Range	Result (dBm)	Verdict
Band4	1.4MHz	QPSK	19957	1RB#0	0.009~0.15	-45.53	PASS
Band4	1.4MHz	QPSK	19957	1RB#0	0.15~30	-39.66	PASS
Band4	1.4MHz	QPSK	19957	1RB#0	30~1000	-60.21	PASS
Band4	1.4MHz	QPSK	19957	1RB#0	1000~3000	-36.74	PASS
Band4	1.4MHz	QPSK	19957	1RB#0	3000~20000	-26.74	PASS
Band4	1.4MHz	QPSK	19957	1RB#5	0.009~0.15	-44.73	PASS
Band4	1.4MHz	QPSK	19957	1RB#5	0.15~30	-38.18	PASS
Band4	1.4MHz	QPSK	19957	1RB#5	30~1000	-60.15	PASS
Band4	1.4MHz	QPSK	19957	1RB#5	1000~3000	-23.21	PASS
Band4	1.4MHz	QPSK	19957	1RB#5	3000~20000	-27.22	PASS
Band4	1.4MHz	QPSK	19957	6RB#0	0.009~0.15	-45.20	PASS
Band4	1.4MHz	QPSK	19957	6RB#0	0.15~30	-40.21	PASS
Band4	1.4MHz	QPSK	19957	6RB#0	30~1000	-60.29	PASS
Band4	1.4MHz	QPSK	19957	6RB#0	1000~3000	-29.72	PASS
Band4	1.4MHz	QPSK	19957	6RB#0	3000~20000	-27.05	PASS
Band4	1.4MHz	16QAM	19957	1RB#0	0.009~0.15	-46.10	PASS
Band4	1.4MHz	16QAM	19957	1RB#0	0.15~30	-40.33	PASS
Band4	1.4MHz	16QAM	19957	1RB#0	30~1000	-60.50	PASS
Band4	1.4MHz	16QAM	19957	1RB#0	1000~3000	-36.29	PASS
Band4	1.4MHz	16QAM	19957	1RB#0	3000~20000	-27.20	PASS
Band4	1.4MHz	16QAM	19957	1RB#5	0.009~0.15	-46.51	PASS
Band4	1.4MHz	16QAM	19957	1RB#5	0.15~30	-41.23	PASS
Band4	1.4MHz	16QAM	19957	1RB#5	30~1000	-60.35	PASS
Band4	1.4MHz	16QAM	19957	1RB#5	1000~3000	-38.94	PASS
Band4	1.4MHz	16QAM	19957	1RB#5	3000~20000	-27.20	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	0.009~0.15	-46.53	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	0.15~30	-39.60	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	30~1000	-60.12	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	1000~3000	-31.64	PASS
Band4	1.4MHz	16QAM	19957	6RB#0	3000~20000	-27.17	PASS
Band4	1.4MHz	QPSK	20175	1RB#0	0.009~0.15	-45.05	PASS
Band4	1.4MHz	QPSK	20175	1RB#0	0.15~30	-40.44	PASS
Band4	1.4MHz	QPSK	20175	1RB#0	30~1000	-60.06	PASS



Shenzhen GUOREN Certification Technology Service Co., Ltd.

101#, Building K & Building T, The Second Industrial Zone, Jiazitang Community,
Fenghuang Street, Guangming District, Shenzhen, China

No.:GRCTR250902006-03

FCC ID:2AEIXZJMT95L

Band4	1.4MHz	QPSK	20175	1RB#0	1000~3000	-45.21	PASS
Band4	1.4MHz	QPSK	20175	1RB#0	3000~20000	-27.02	PASS
Band4	1.4MHz	QPSK	20175	1RB#5	0.009~0.15	-45.34	PASS
Band4	1.4MHz	QPSK	20175	1RB#5	0.15~30	-38.42	PASS
Band4	1.4MHz	QPSK	20175	1RB#5	30~1000	-60.13	PASS
Band4	1.4MHz	QPSK	20175	1RB#5	1000~3000	-29.90	PASS
Band4	1.4MHz	QPSK	20175	1RB#5	3000~20000	-27.05	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	0.009~0.15	-45.61	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	0.15~30	-38.67	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	30~1000	-60.36	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	1000~3000	-44.75	PASS
Band4	1.4MHz	QPSK	20175	6RB#0	3000~20000	-27.32	PASS
Band4	1.4MHz	16QAM	20175	1RB#0	0.009~0.15	-46.60	PASS
Band4	1.4MHz	16QAM	20175	1RB#0	0.15~30	-41.11	PASS
Band4	1.4MHz	16QAM	20175	1RB#0	30~1000	-60.37	PASS
Band4	1.4MHz	16QAM	20175	1RB#0	1000~3000	-35.94	PASS
Band4	1.4MHz	16QAM	20175	1RB#0	3000~20000	-26.74	PASS
Band4	1.4MHz	16QAM	20175	1RB#5	0.009~0.15	-43.11	PASS
Band4	1.4MHz	16QAM	20175	1RB#5	0.15~30	-36.98	PASS
Band4	1.4MHz	16QAM	20175	1RB#5	30~1000	-60.34	PASS
Band4	1.4MHz	16QAM	20175	1RB#5	1000~3000	-45.30	PASS
Band4	1.4MHz	16QAM	20175	1RB#5	3000~20000	-26.74	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	0.009~0.15	-45.36	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	0.15~30	-40.21	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	30~1000	-60.41	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	1000~3000	-45.06	PASS
Band4	1.4MHz	16QAM	20175	6RB#0	3000~20000	-27.15	PASS
Band4	1.4MHz	QPSK	20393	1RB#0	0.009~0.15	-43.63	PASS
Band4	1.4MHz	QPSK	20393	1RB#0	0.15~30	-38.87	PASS
Band4	1.4MHz	QPSK	20393	1RB#0	30~1000	-60.15	PASS
Band4	1.4MHz	QPSK	20393	1RB#0	1000~3000	-38.99	PASS
Band4	1.4MHz	QPSK	20393	1RB#0	3000~20000	-26.94	PASS
Band4	1.4MHz	QPSK	20393	1RB#5	0.009~0.15	-45.86	PASS
Band4	1.4MHz	QPSK	20393	1RB#5	0.15~30	-39.85	PASS
Band4	1.4MHz	QPSK	20393	1RB#5	30~1000	-60.25	PASS
Band4	1.4MHz	QPSK	20393	1RB#5	1000~3000	-36.07	PASS
Band4	1.4MHz	QPSK	20393	1RB#5	3000~20000	-26.66	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	0.009~0.15	-44.86	PASS
Band4	1.4MHz	QPSK	20393	6RB#0	0.15~30	-40.09	PASS