



Appendix D: Band Edge

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dBm)	Verdict
Band66	1.4MHz	QPSK	131979	1RB#0	-22.74	PASS
Band66	1.4MHz	QPSK	131979	1RB#5	-40.04	PASS
Band66	1.4MHz	QPSK	131979	6RB#0	-28.46	PASS
Band66	1.4MHz	16QAM	131979	1RB#0	-23.51	PASS
Band66	1.4MHz	16QAM	131979	1RB#5	-42.31	PASS
Band66	1.4MHz	16QAM	131979	6RB#0	-25.99	PASS
Band66	1.4MHz	QPSK	132665	1RB#0	-41.06	PASS
Band66	1.4MHz	QPSK	132665	1RB#5	-24.24	PASS
Band66	1.4MHz	QPSK	132665	6RB#0	-26.79	PASS
Band66	1.4MHz	16QAM	132665	1RB#0	-42.17	PASS
Band66	1.4MHz	16QAM	132665	1RB#5	-23.60	PASS
Band66	1.4MHz	16QAM	132665	6RB#0	-28.63	PASS
Band66	3MHz	QPSK	131987	1RB#0	-18.79	PASS
Band66	3MHz	QPSK	131987	1RB#14	-48.21	PASS
Band66	3MHz	QPSK	131987	15RB#0	-30.61	PASS
Band66	3MHz	16QAM	131987	1RB#0	-19.98	PASS
Band66	3MHz	16QAM	131987	1RB#14	-49.38	PASS
Band66	3MHz	16QAM	131987	15RB#0	-29.95	PASS
Band66	3MHz	QPSK	132657	1RB#0	-48.67	PASS
Band66	3MHz	QPSK	132657	1RB#14	-17.95	PASS
Band66	3MHz	QPSK	132657	15RB#0	-30.91	PASS
Band66	3MHz	16QAM	132657	1RB#0	-49.44	PASS
Band66	3MHz	16QAM	132657	1RB#14	-19.48	PASS
Band66	3MHz	16QAM	132657	15RB#0	-30.99	PASS
Band66	5MHz	QPSK	131997	1RB#0	-20.73	PASS
Band66	5MHz	QPSK	131997	1RB#24	-52.62	PASS
Band66	5MHz	QPSK	131997	25RB#0	-33.49	PASS
Band66	5MHz	16QAM	131997	1RB#0	-22.17	PASS
Band66	5MHz	16QAM	131997	1RB#24	-52.75	PASS
Band66	5MHz	16QAM	131997	25RB#0	-33.59	PASS
Band66	5MHz	QPSK	132647	1RB#0	-52.83	PASS
Band66	5MHz	QPSK	132647	1RB#24	-22.47	PASS
Band66	5MHz	QPSK	132647	25RB#0	-33.30	PASS



Shenzhen GUOREN Certification Technology Service Co., Ltd.

101#, Building K & Building T, The Second Industrial Zone, Jiazitang Community,
Fenghuang Street, Guangming District, Shenzhen, China


No.:GRCTR250902006-07

FCC ID:2AEIXZJMT95L

Band66	5MHz	16QAM	132647	1RB#0	-53.05	PASS
Band66	5MHz	16QAM	132647	1RB#24	-22.63	PASS
Band66	5MHz	16QAM	132647	25RB#0	-34.31	PASS
Band66	10MHz	QPSK	132022	1RB#0	-29.97	PASS
Band66	10MHz	QPSK	132022	1RB#49	-50.19	PASS
Band66	10MHz	QPSK	132022	50RB#0	-37.08	PASS
Band66	10MHz	16QAM	132022	1RB#0	-31.55	PASS
Band66	10MHz	16QAM	132022	1RB#49	-50.44	PASS
Band66	10MHz	QPSK	132622	1RB#0	-49.81	PASS
Band66	10MHz	QPSK	132622	1RB#49	-30.52	PASS
Band66	10MHz	QPSK	132622	50RB#0	-36.22	PASS
Band66	10MHz	16QAM	132622	1RB#0	-50.44	PASS
Band66	10MHz	16QAM	132622	1RB#49	-31.81	PASS
Band66	15MHz	QPSK	132047	1RB#0	-36.73	PASS
Band66	15MHz	QPSK	132047	1RB#74	-48.63	PASS
Band66	15MHz	QPSK	132047	75RB#0	-38.60	PASS
Band66	15MHz	16QAM	132047	1RB#0	-38.02	PASS
Band66	15MHz	16QAM	132047	1RB#74	-49.19	PASS
Band66	15MHz	QPSK	132597	1RB#0	-48.56	PASS
Band66	15MHz	QPSK	132597	1RB#74	-35.88	PASS
Band66	15MHz	QPSK	132597	75RB#0	-36.82	PASS
Band66	15MHz	16QAM	132597	1RB#0	-48.77	PASS
Band66	15MHz	16QAM	132597	1RB#74	-36.87	PASS
Band66	20MHz	QPSK	132072	1RB#0	-40.71	PASS
Band66	20MHz	QPSK	132072	1RB#99	-47.51	PASS
Band66	20MHz	QPSK	132072	100RB#0	-38.61	PASS
Band66	20MHz	16QAM	132072	1RB#0	-40.98	PASS
Band66	20MHz	16QAM	132072	1RB#99	-48.18	PASS
Band66	20MHz	QPSK	132572	1RB#0	-47.43	PASS
Band66	20MHz	QPSK	132572	1RB#99	-38.97	PASS
Band66	20MHz	QPSK	132572	100RB#0	-36.62	PASS
Band66	20MHz	16QAM	132572	1RB#0	-47.64	PASS
Band66	20MHz	16QAM	132572	1RB#99	-39.90	PASS

FCC ID:2AEIXZJMT95L

Test Graphs

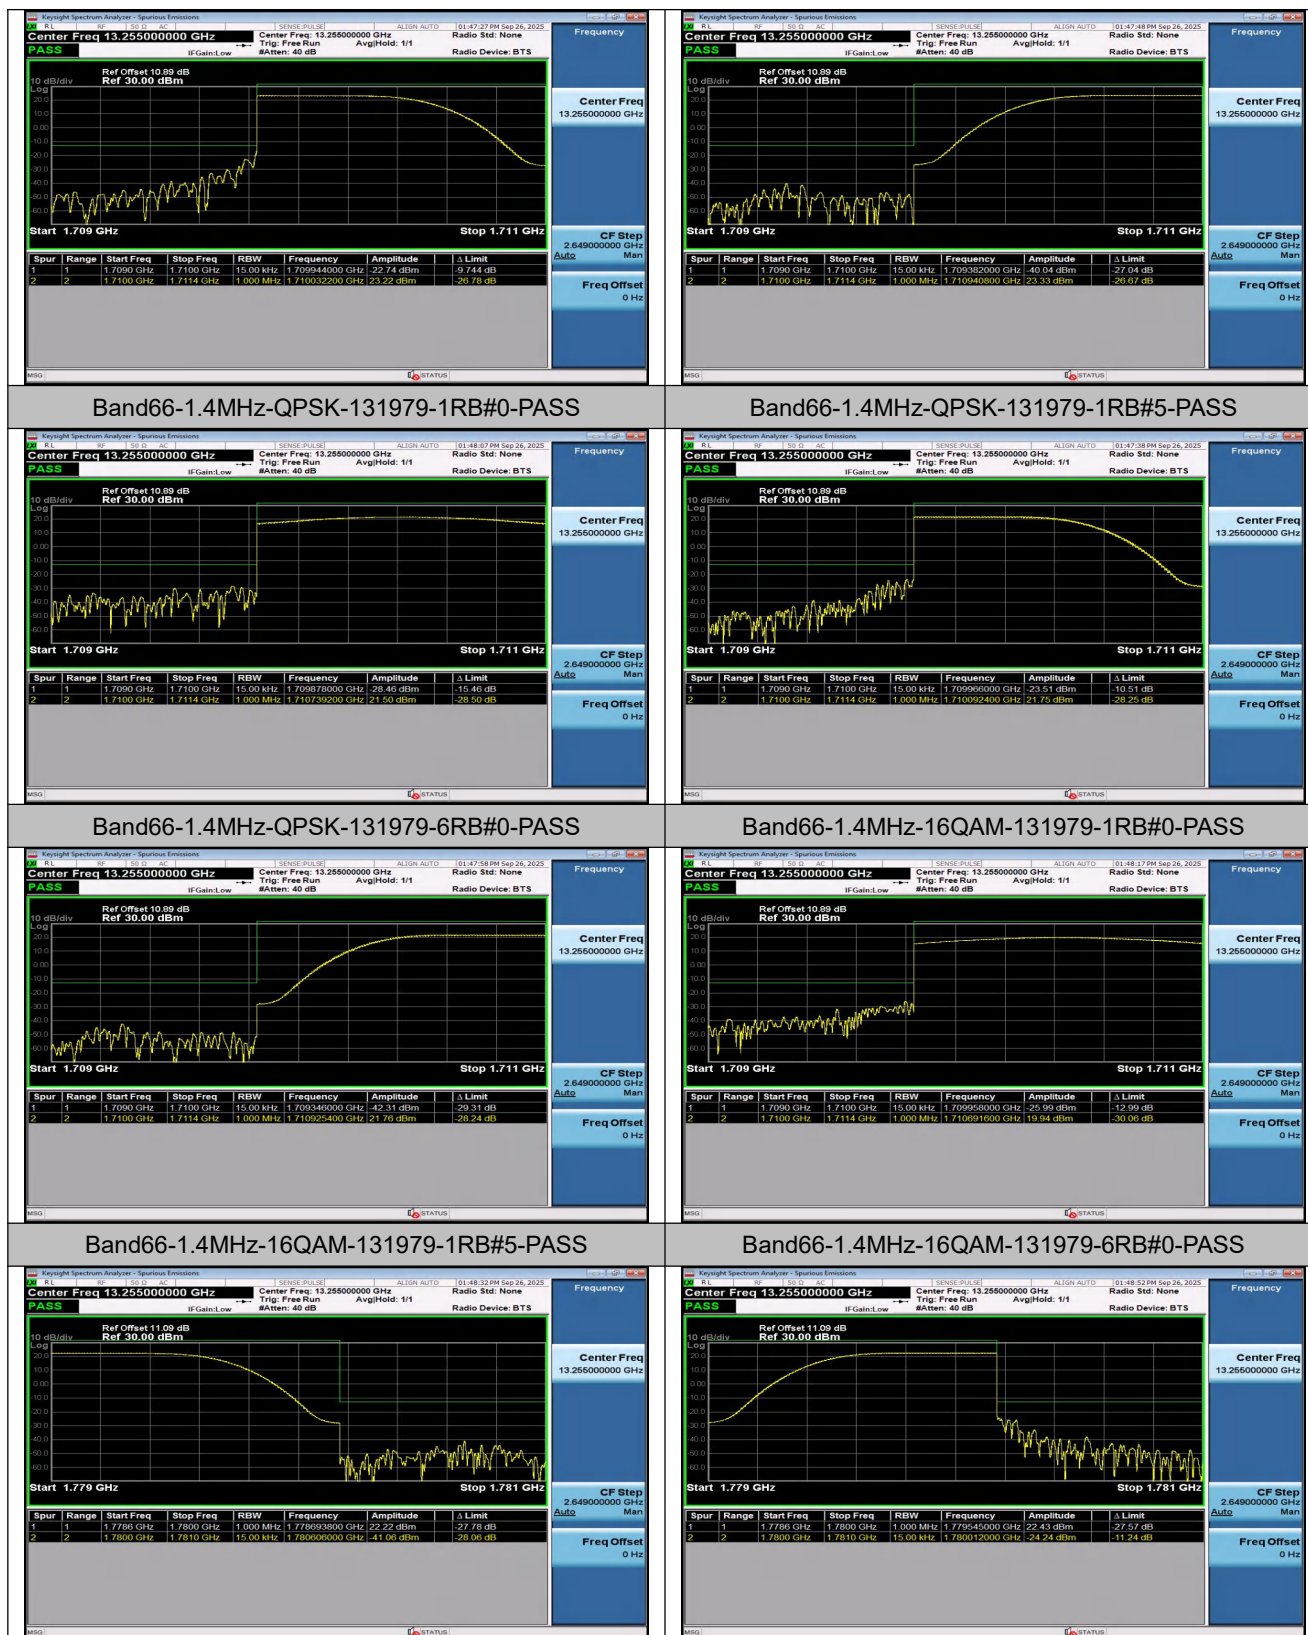




Shenzhen GUOREN Certification Technology Service Co., Ltd.

101#, Building K & Building T, The Second Industrial Zone, Jiazitang Community,
Fenghuang Street, Guangming District, Shenzhen, China

No.:GRCTR250902006-07

FCC ID:2AEIXZJMT95L

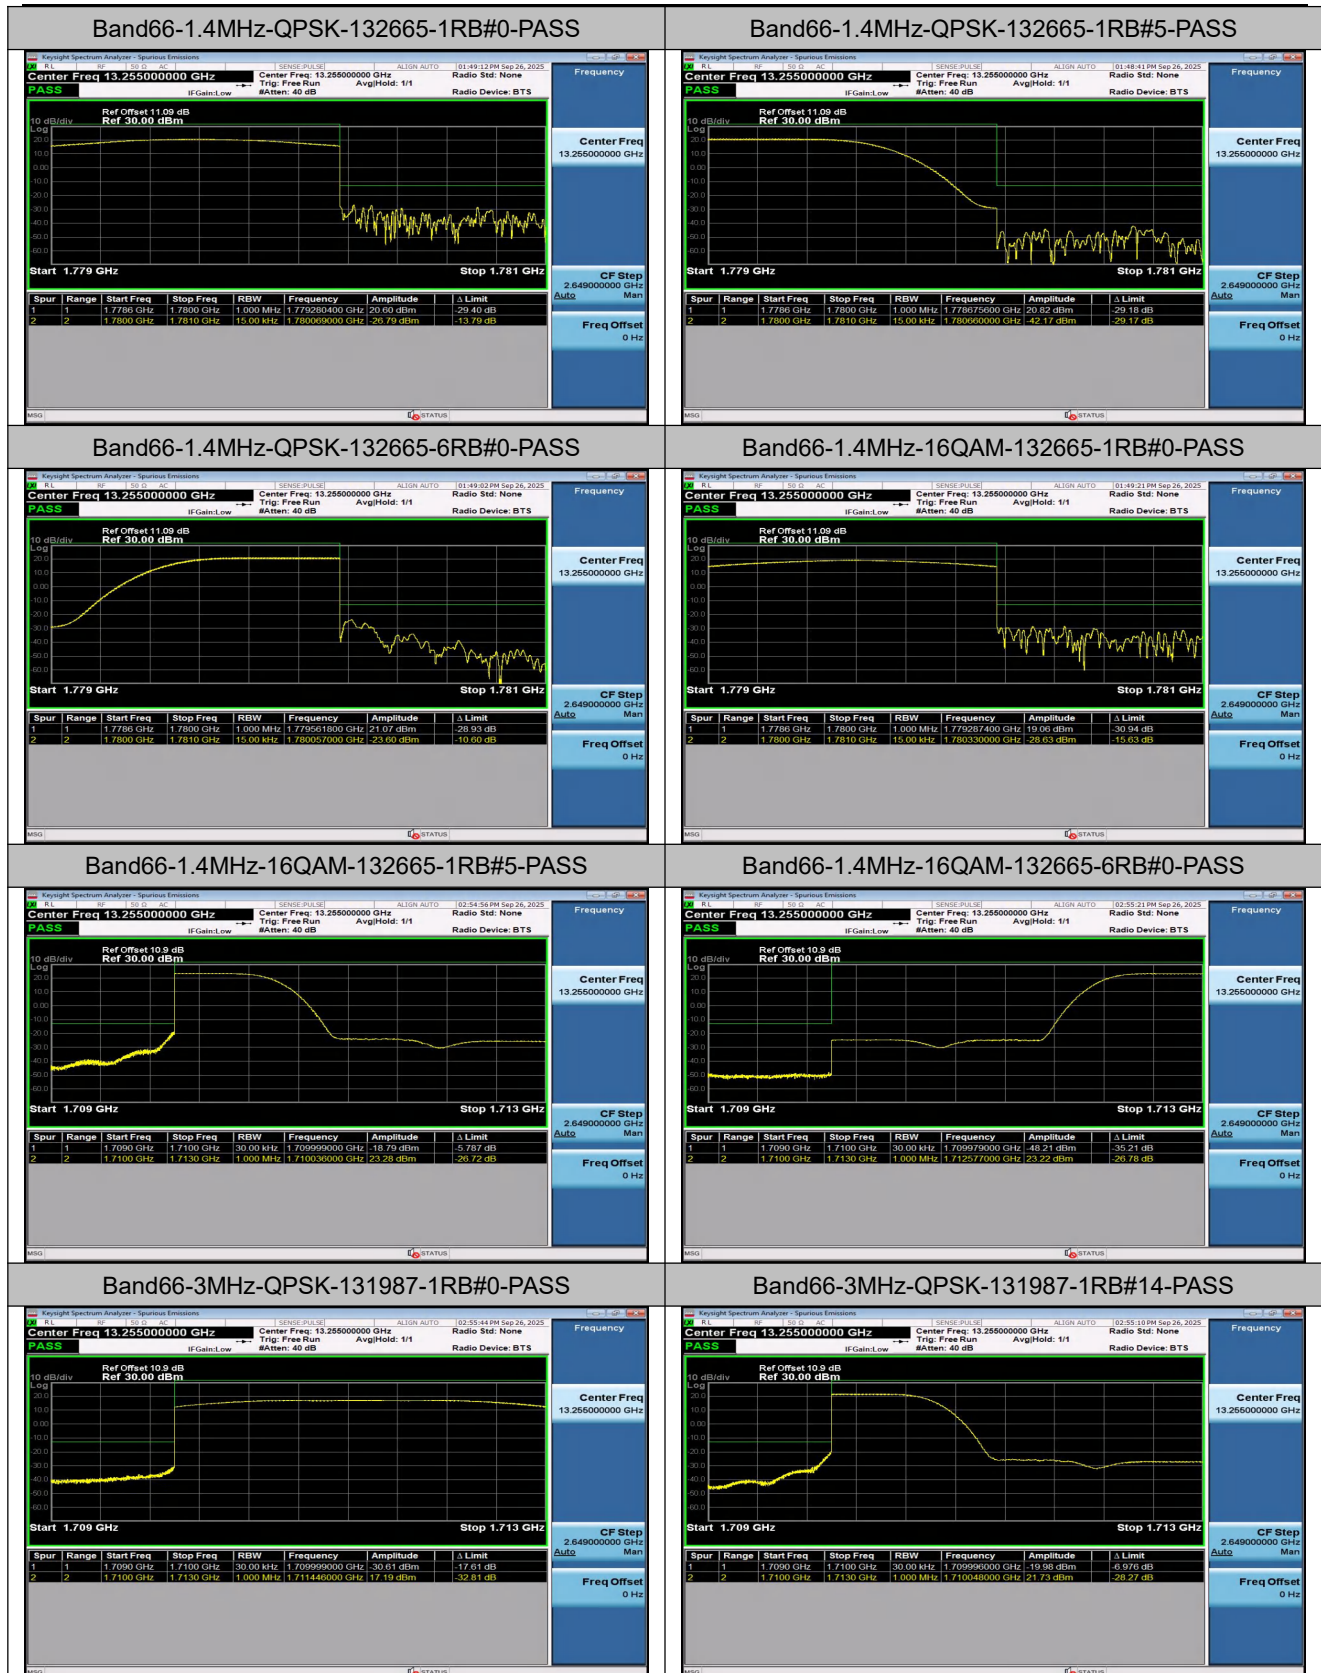




Shenzhen GUOREN Certification Technology Service Co., Ltd.

101#, Building K & Building T, The Second Industrial Zone, Jiazitang Community,
Fenghuang Street, Guangming District, Shenzhen, China

No.:GRCTR250902006-07

FCC ID:2AEIXZJMT95L

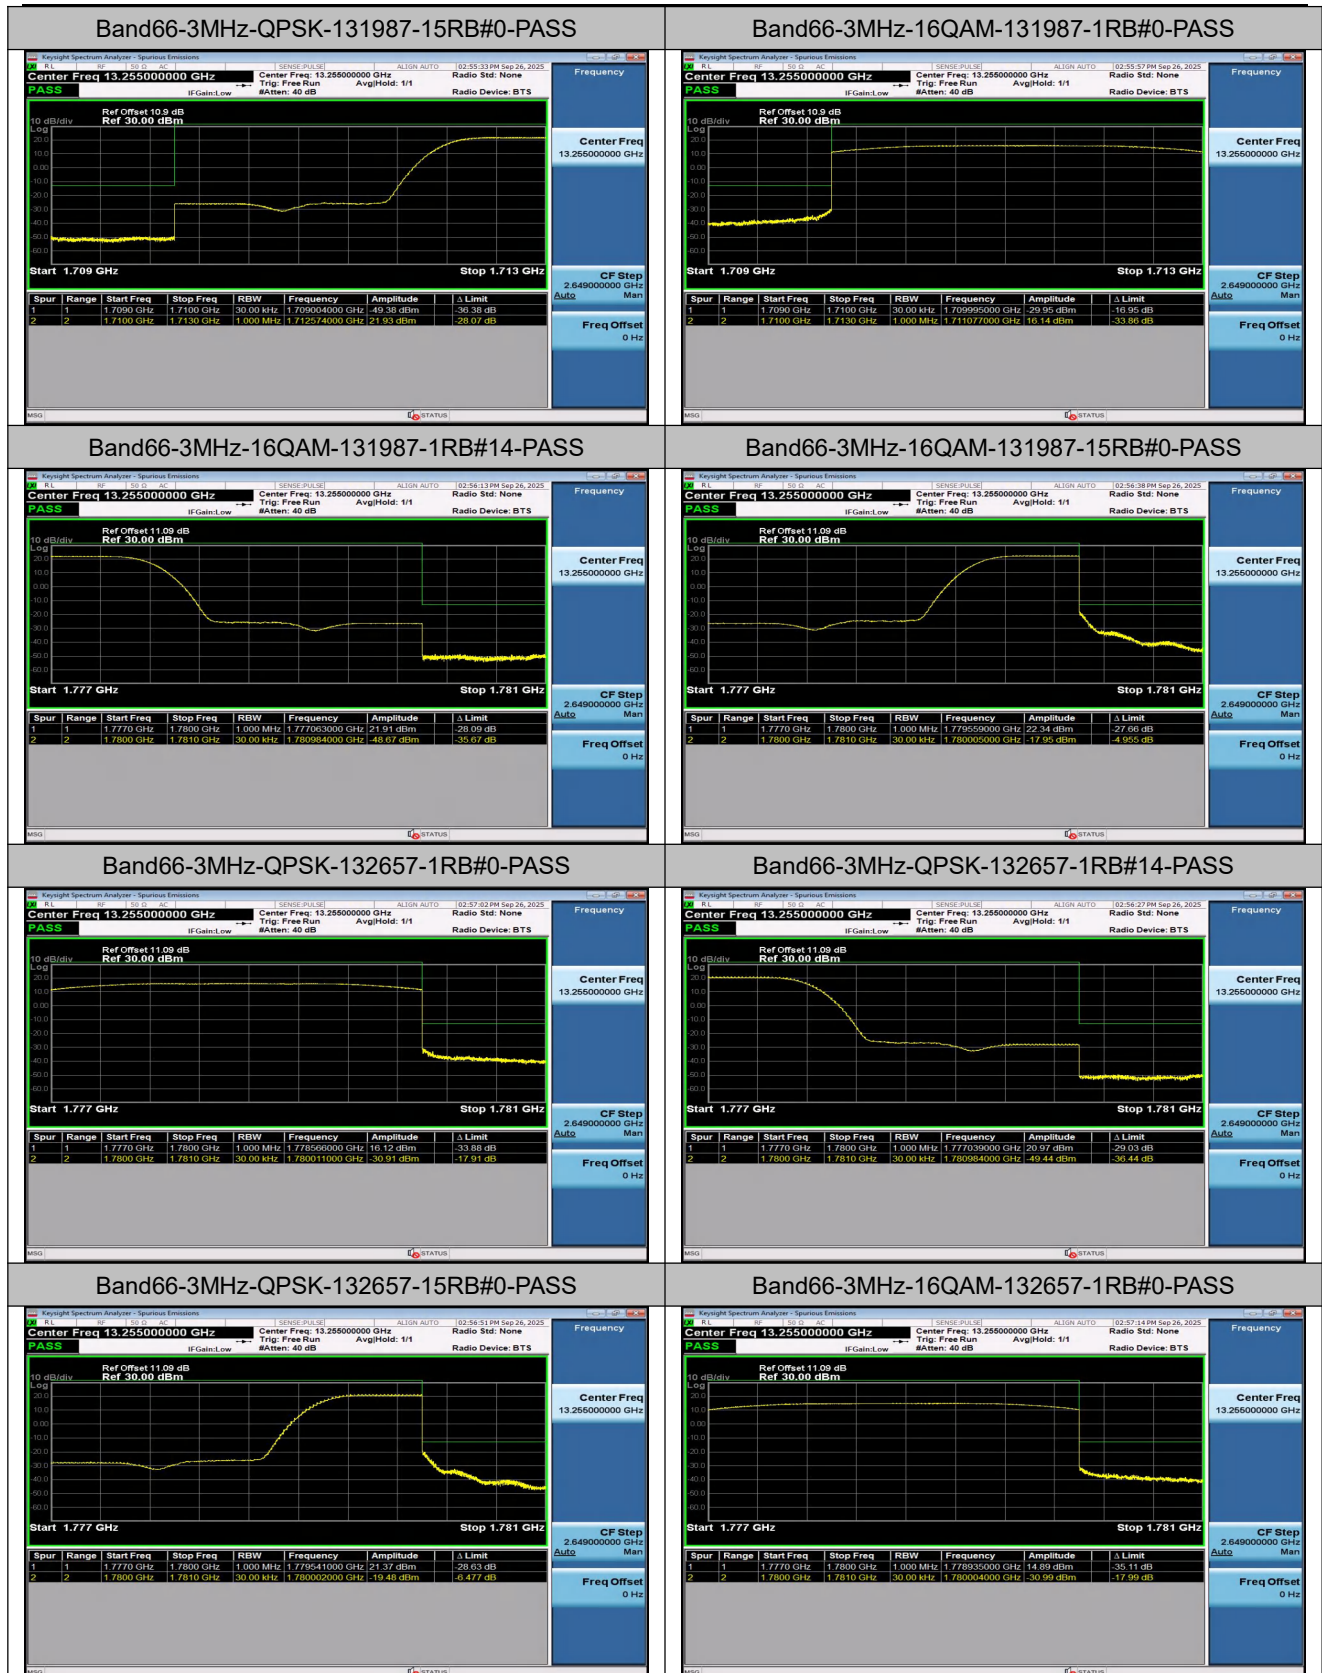




Shenzhen GUOREN Certification Technology Service Co., Ltd.

101#, Building K & Building T, The Second Industrial Zone, Jiazitang Community,
Fenghuang Street, Guangming District, Shenzhen, China

No.:GRCTR250902006-07

FCC ID:2AEIXZJMT95L

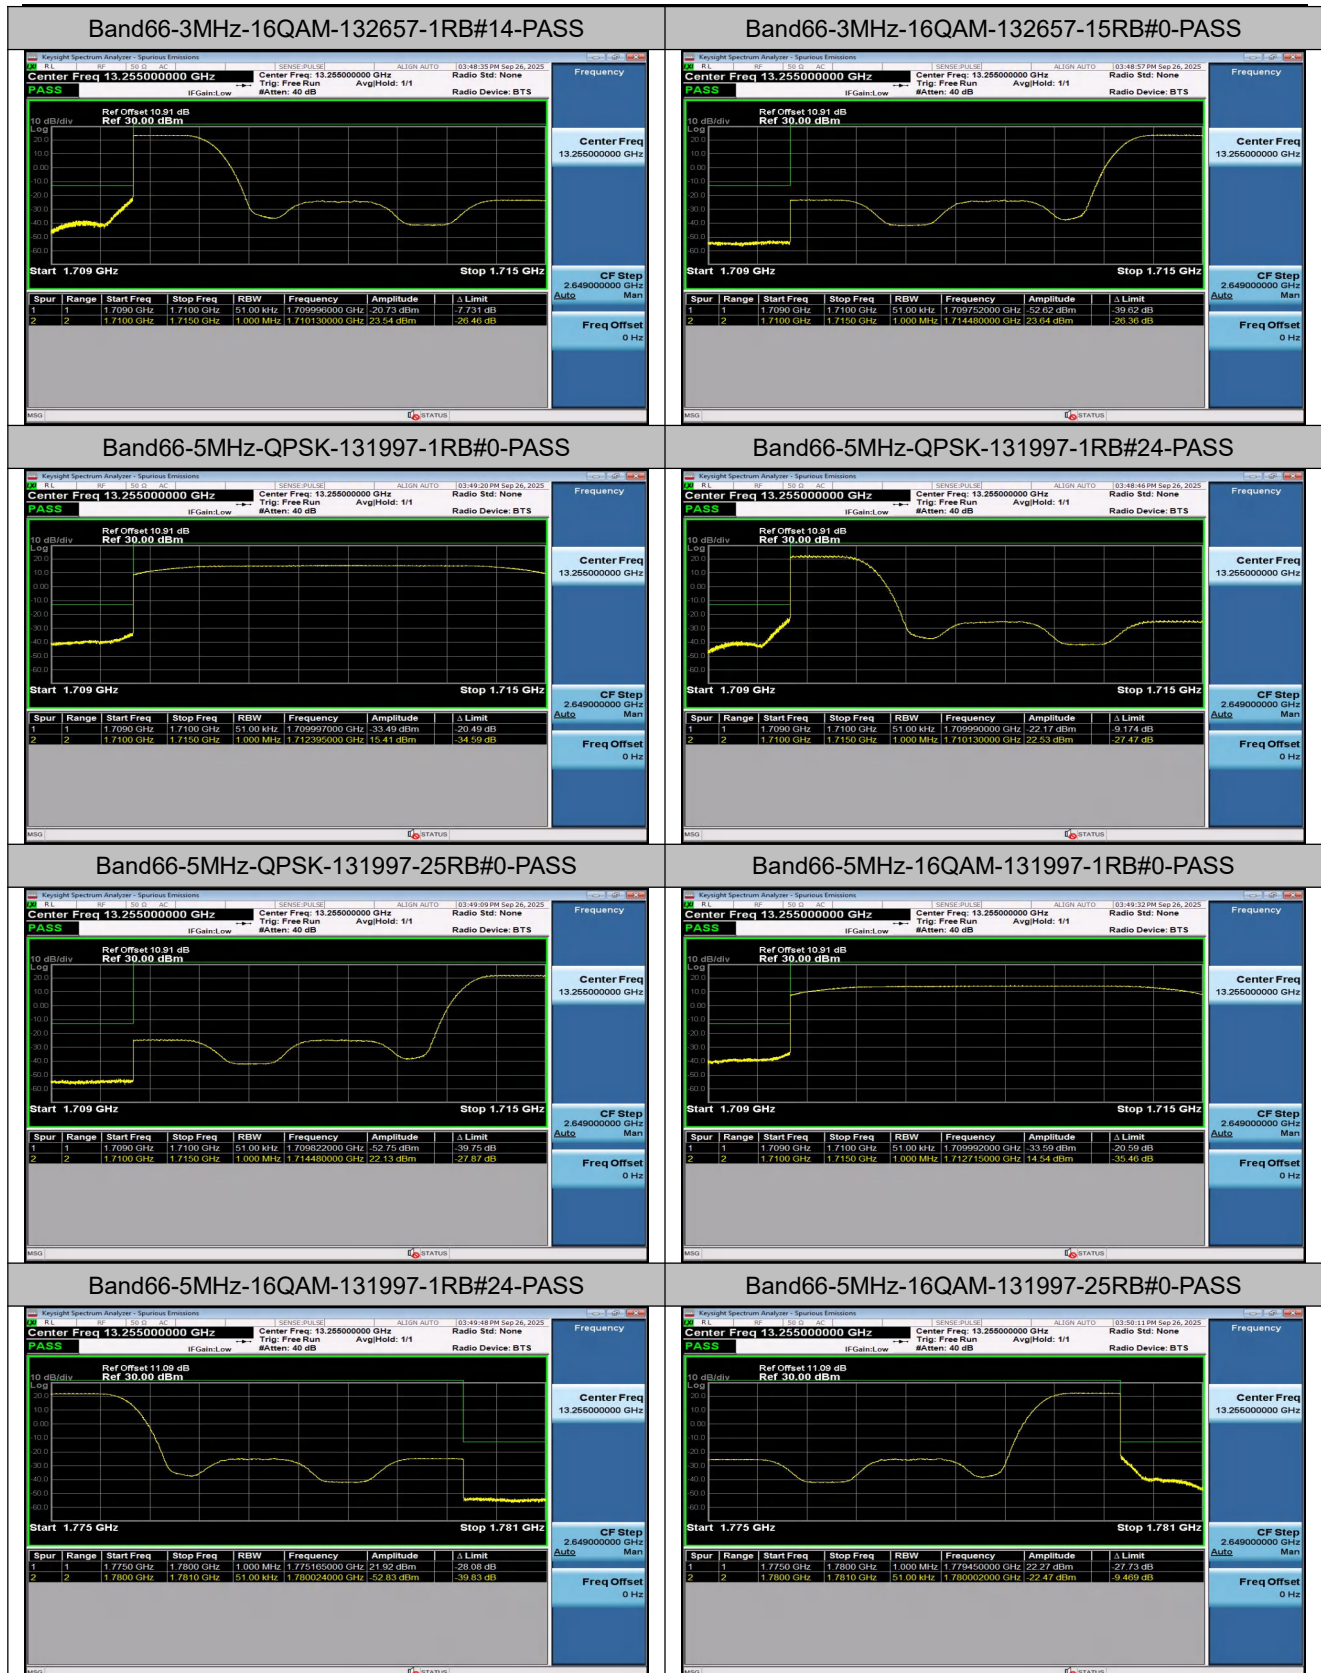




Shenzhen GUOREN Certification Technology Service Co., Ltd.

101#, Building K & Building T, The Second Industrial Zone, Jiazitang Community,
Fenghuang Street, Guangming District, Shenzhen, China

No.:GRCTR250902006-07

FCC ID:2AEIXZJMT95L

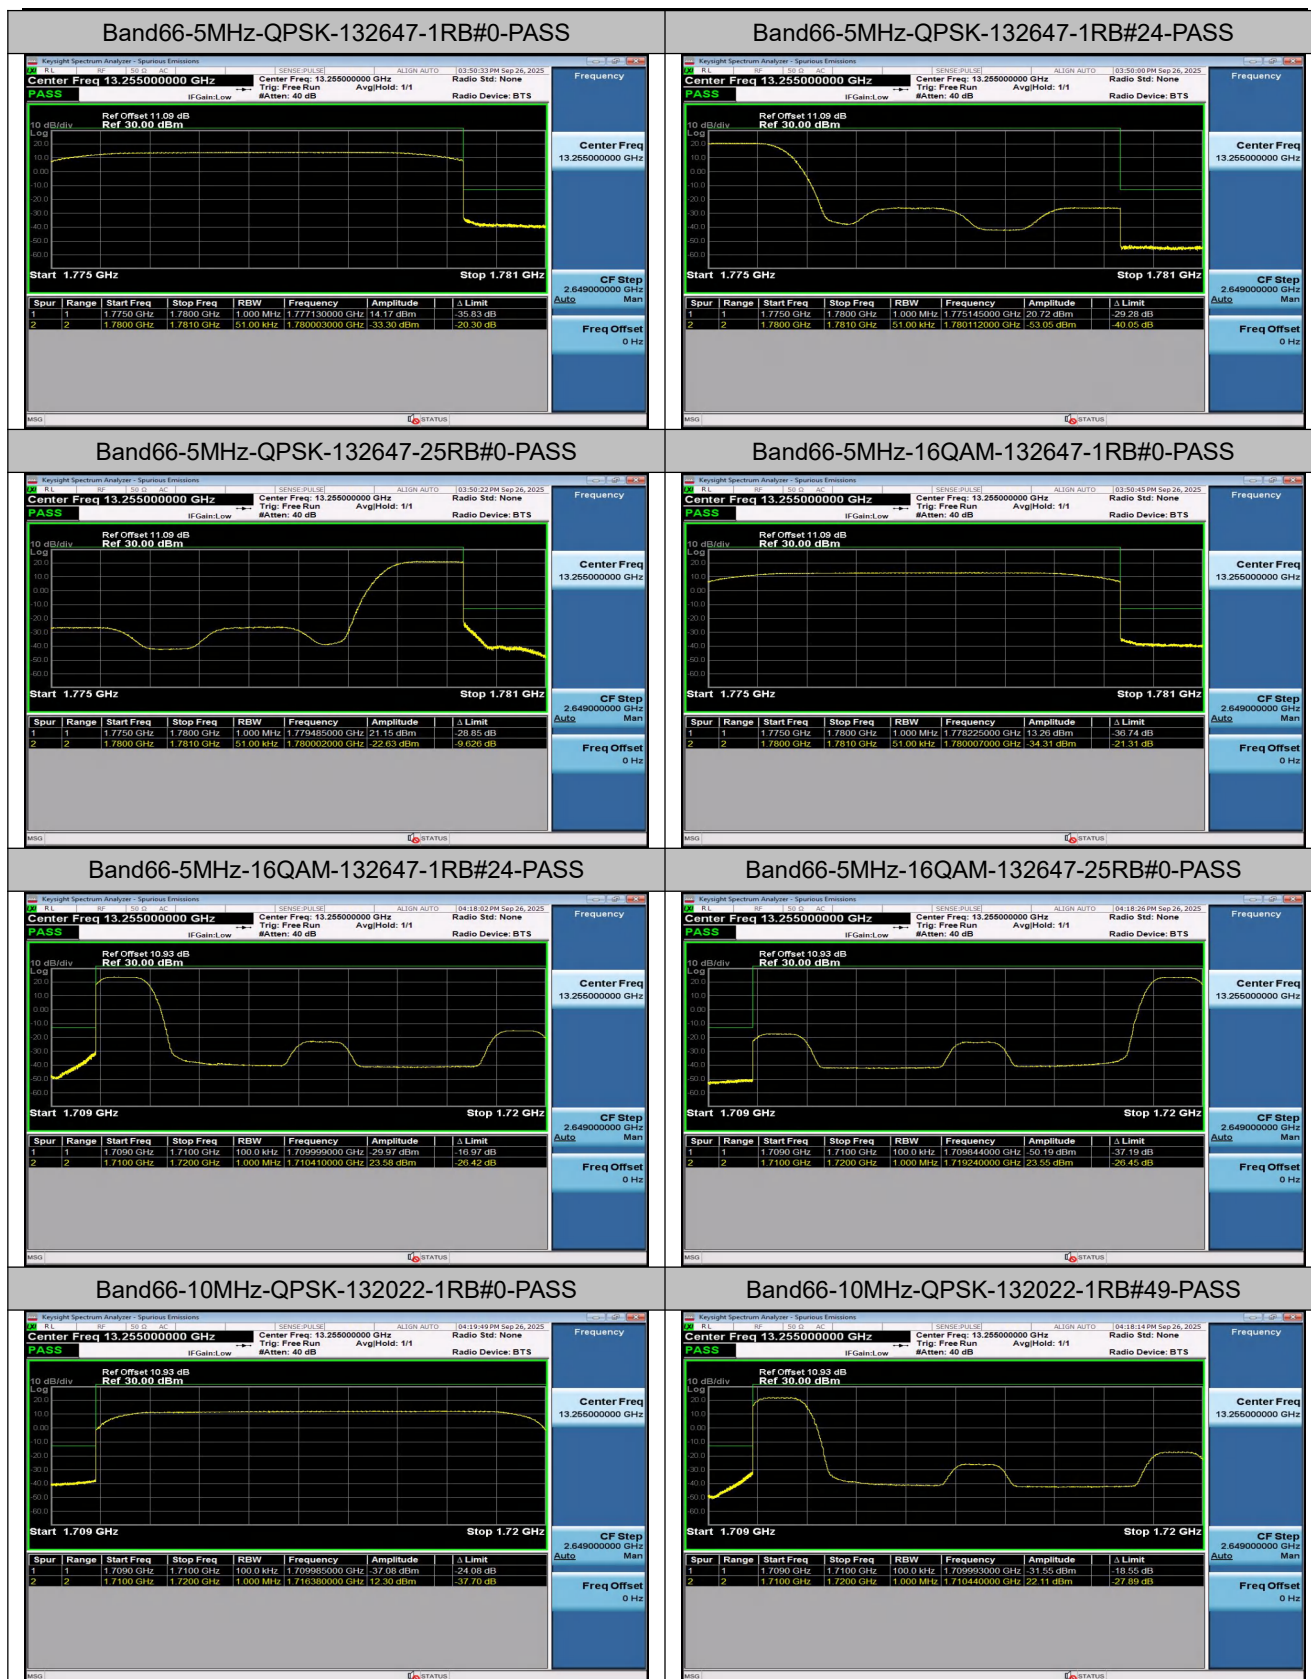




Shenzhen GUOREN Certification Technology Service Co., Ltd.

101#, Building K & Building T, The Second Industrial Zone, Jiazitang Community,
Fenghuang Street, Guangming District, Shenzhen, China

No.:GRCTR250902006-07

FCC ID:2AEIXZJMT95L

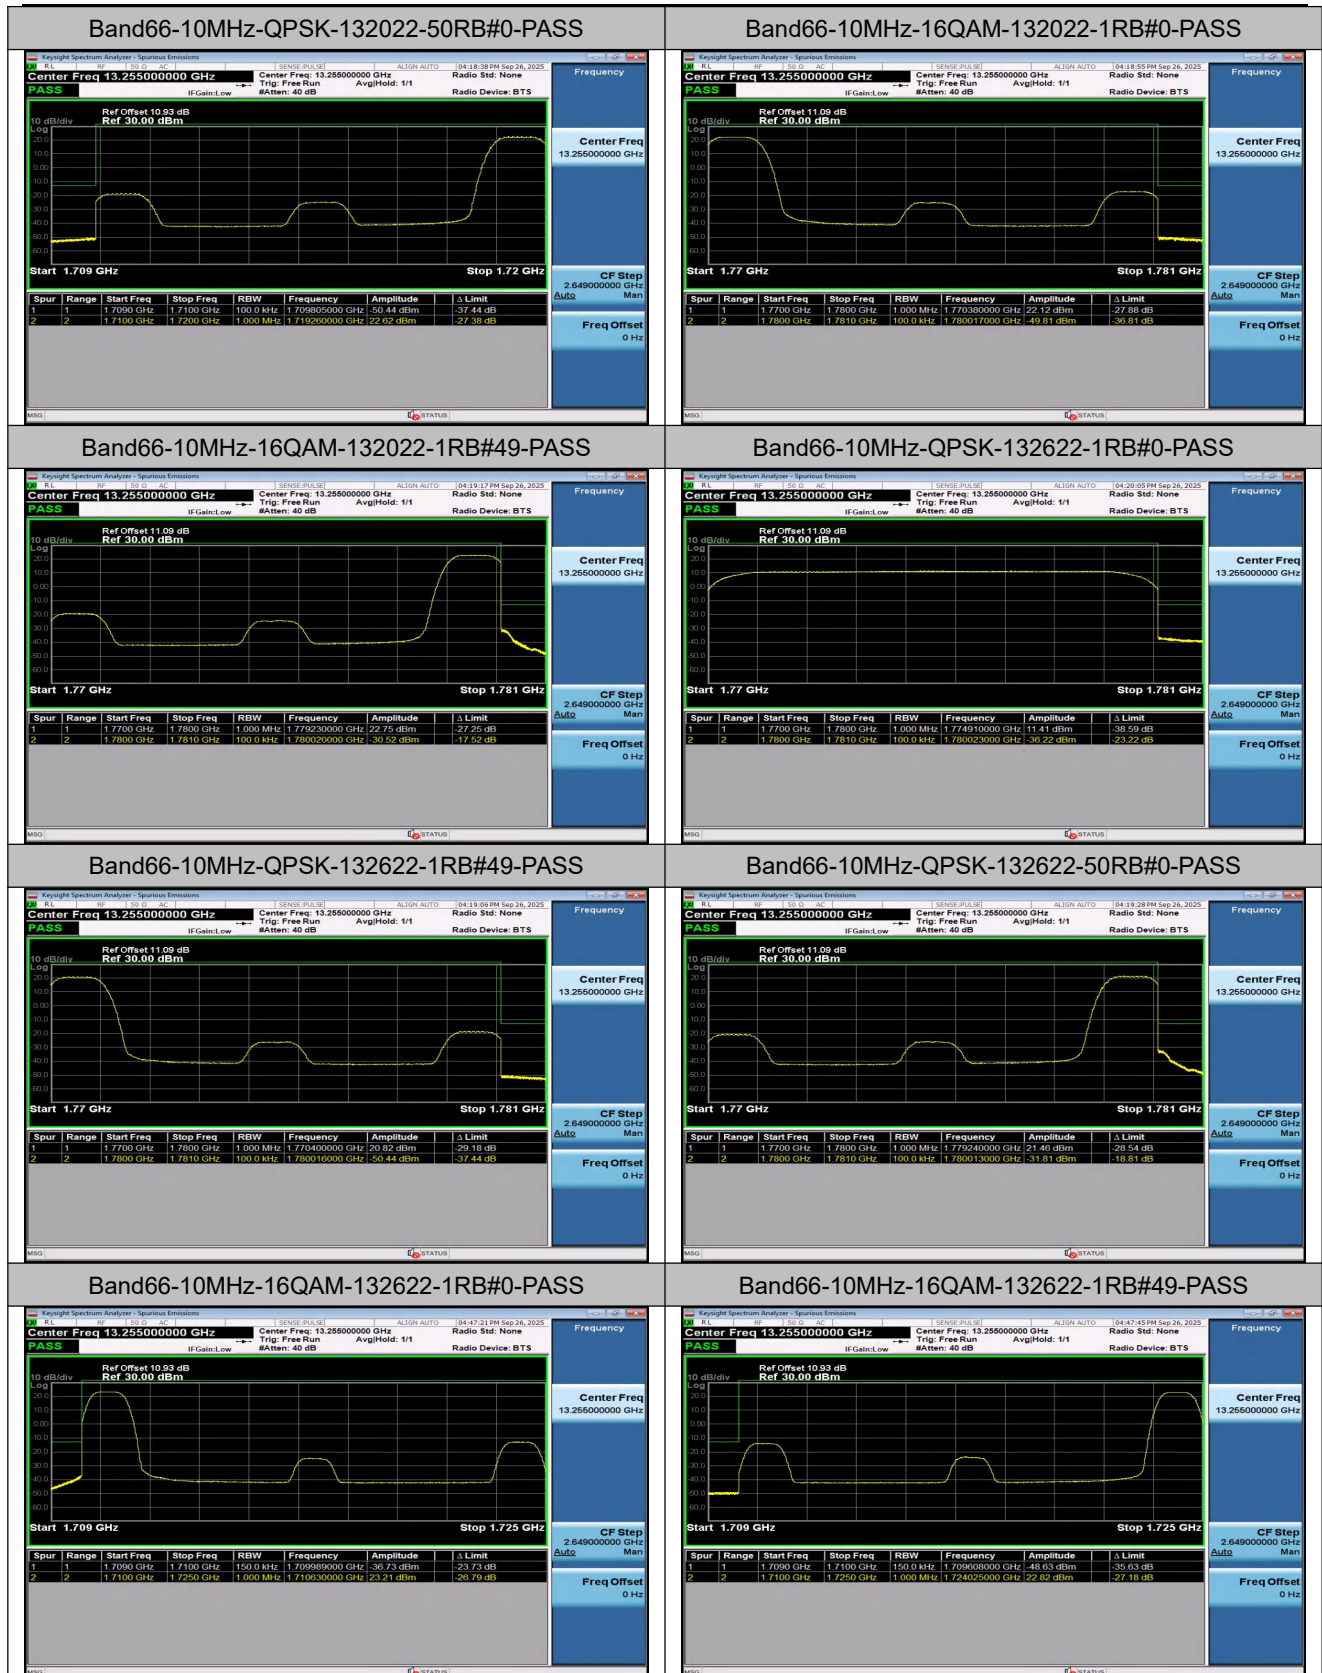




Shenzhen GUOREN Certification Technology Service Co., Ltd.

101#, Building K & Building T, The Second Industrial Zone, Jiazitang Community,
Fenghuang Street, Guangming District, Shenzhen, China

No.:GRCTR250902006-07

FCC ID:2AEIXZJMT95L

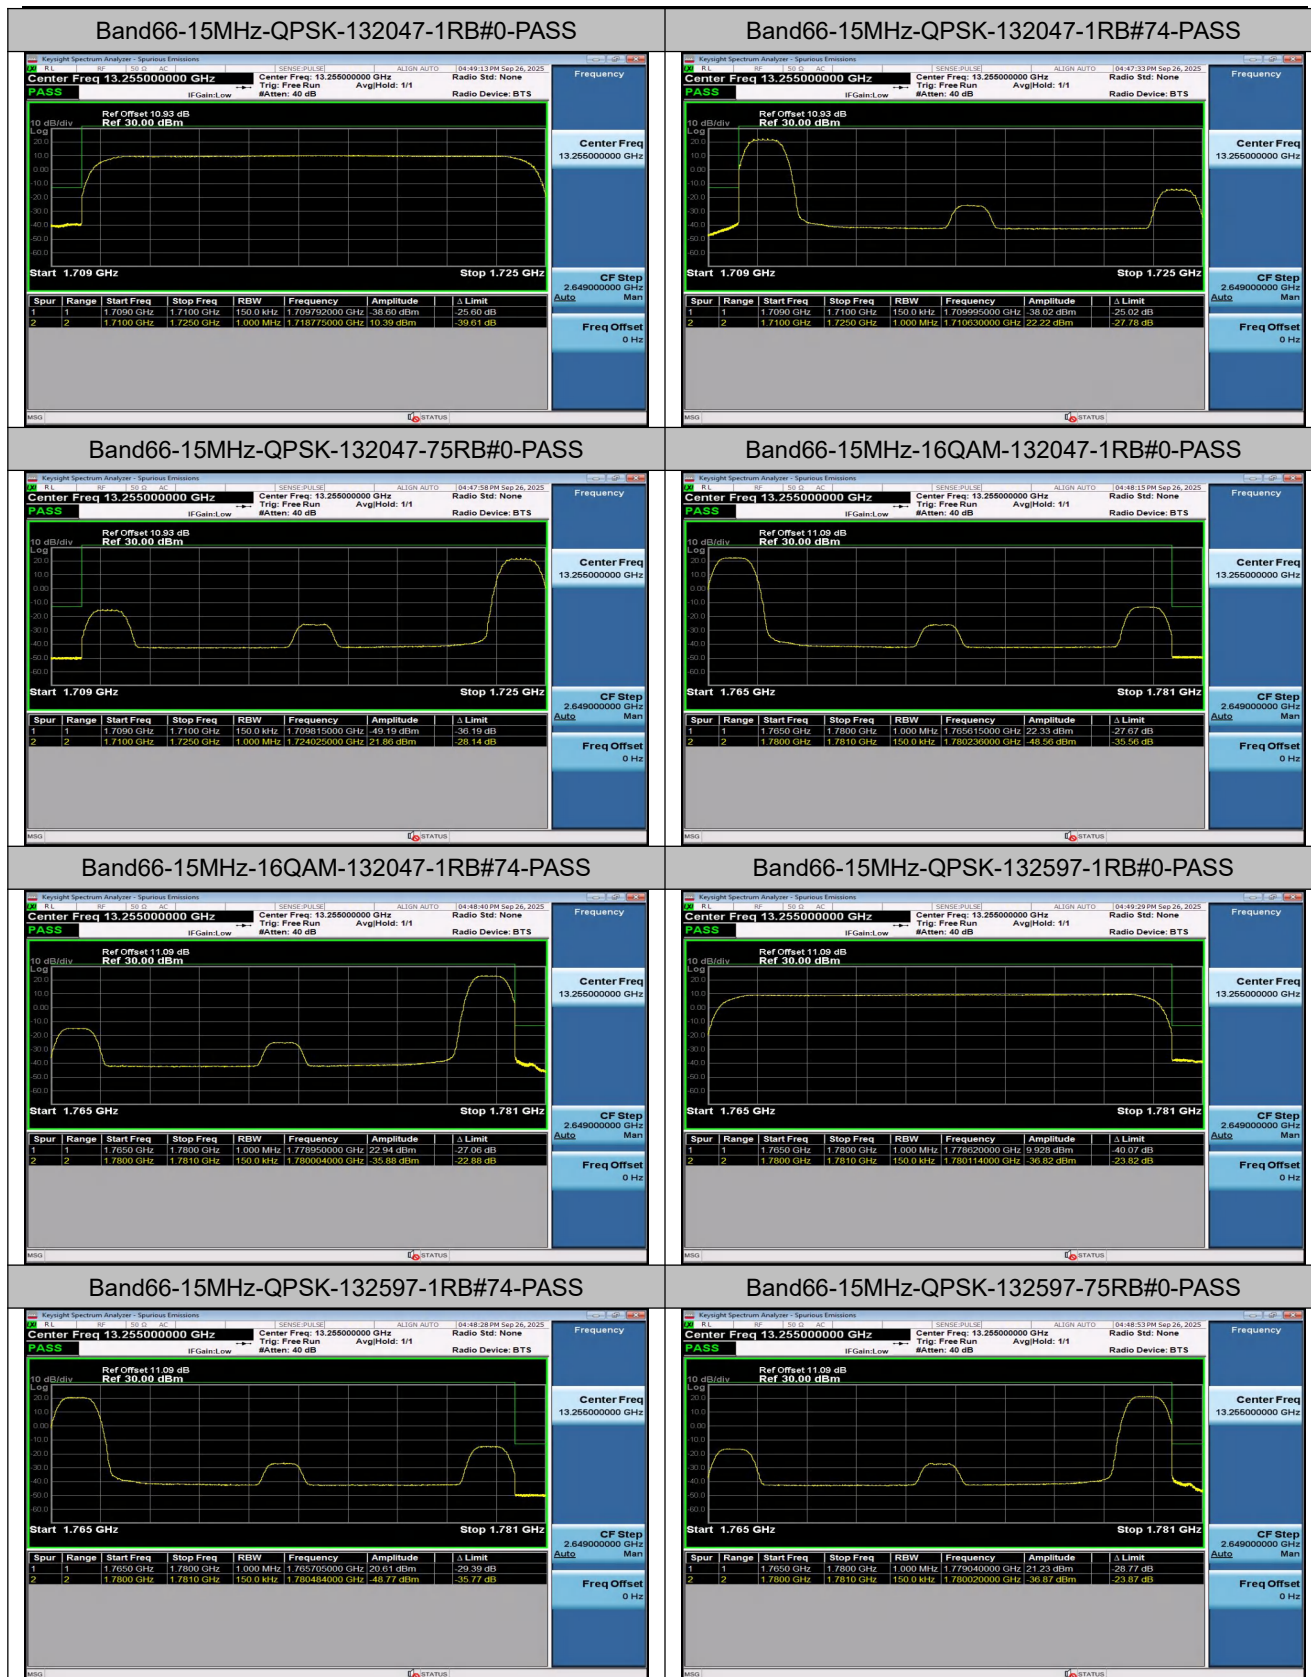




Shenzhen GUOREN Certification Technology Service Co., Ltd.

101#, Building K & Building T, The Second Industrial Zone, Jiazitang Community,
Fenghuang Street, Guangming District, Shenzhen, China

No.:GRCTR250902006-07

FCC ID:2AEIXZJMT95L

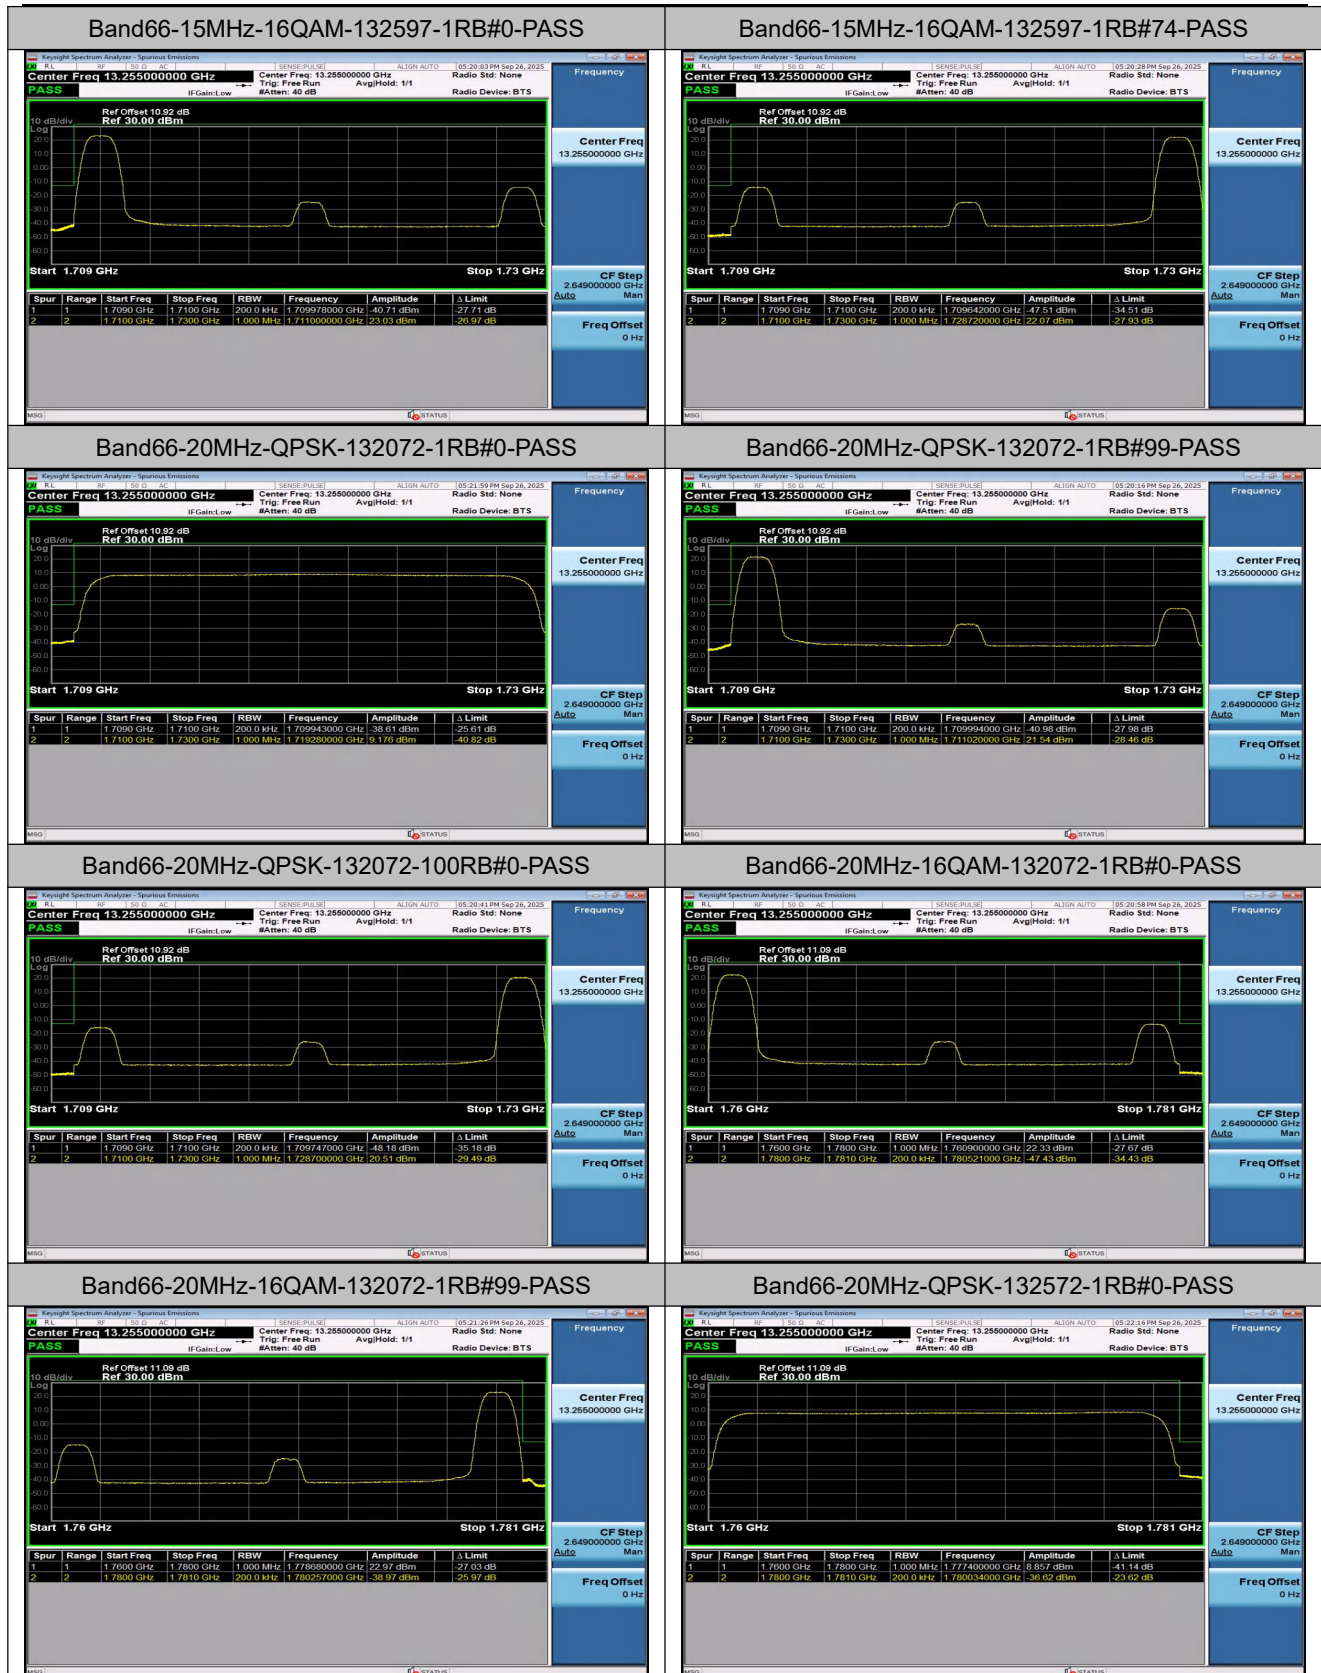




Shenzhen GUOREN Certification Technology Service Co., Ltd.

101#, Building K & Building T, The Second Industrial Zone, Jiazitang Community,
Fenghuang Street, Guangming District, Shenzhen, China

No.:GRCTR250902006-07

FCC ID:2AEIXZJMT95L

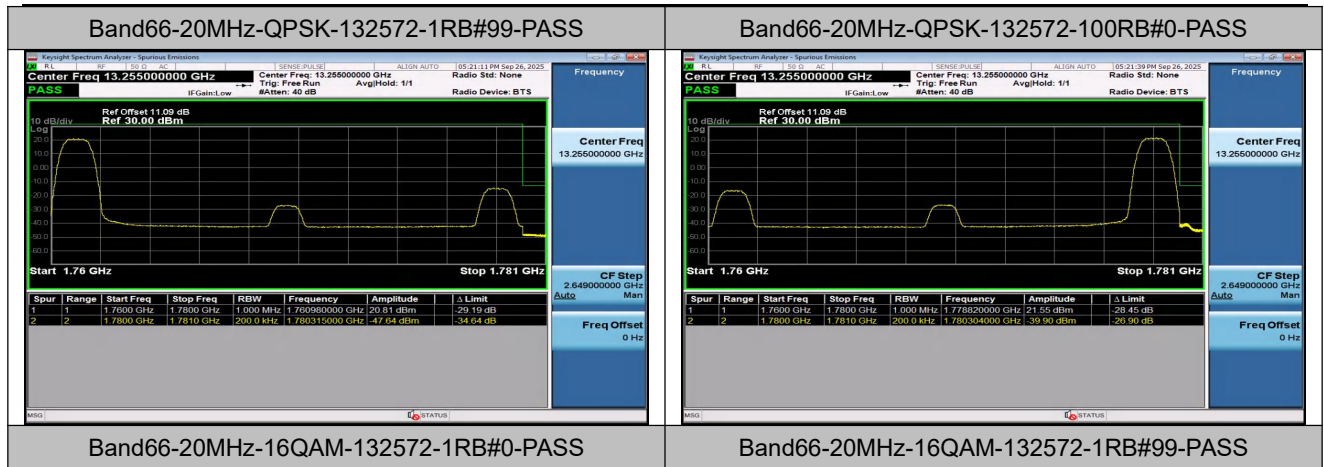



Appendix E: Conducted Spurious Emission

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Frequency Range	Result (dBm)	Verdict
Band66	1.4MHz	QPSK	131979	1RB#0	0.009~0.15	-46.55	PASS
Band66	1.4MHz	QPSK	131979	1RB#0	0.15~30	-38.29	PASS
Band66	1.4MHz	QPSK	131979	1RB#0	30~1000	-60.12	PASS
Band66	1.4MHz	QPSK	131979	1RB#0	1000~3000	-37.04	PASS
Band66	1.4MHz	QPSK	131979	1RB#0	3000~20000	-26.99	PASS
Band66	1.4MHz	QPSK	131979	1RB#5	0.009~0.15	-45.77	PASS
Band66	1.4MHz	QPSK	131979	1RB#5	0.15~30	-37.56	PASS
Band66	1.4MHz	QPSK	131979	1RB#5	30~1000	-60.31	PASS
Band66	1.4MHz	QPSK	131979	1RB#5	1000~3000	-39.68	PASS
Band66	1.4MHz	QPSK	131979	1RB#5	3000~20000	-26.59	PASS
Band66	1.4MHz	QPSK	131979	6RB#0	0.009~0.15	-45.67	PASS
Band66	1.4MHz	QPSK	131979	6RB#0	0.15~30	-36.58	PASS
Band66	1.4MHz	QPSK	131979	6RB#0	30~1000	-59.96	PASS
Band66	1.4MHz	QPSK	131979	6RB#0	1000~3000	-30.31	PASS
Band66	1.4MHz	QPSK	131979	6RB#0	3000~20000	-26.57	PASS
Band66	1.4MHz	16QAM	131979	1RB#0	0.009~0.15	-45.37	PASS
Band66	1.4MHz	16QAM	131979	1RB#0	0.15~30	-37.75	PASS
Band66	1.4MHz	16QAM	131979	1RB#0	30~1000	-60.16	PASS
Band66	1.4MHz	16QAM	131979	1RB#0	1000~3000	-37.95	PASS
Band66	1.4MHz	16QAM	131979	1RB#0	3000~20000	-27.06	PASS
Band66	1.4MHz	16QAM	131979	1RB#5	0.009~0.15	-46.31	PASS
Band66	1.4MHz	16QAM	131979	1RB#5	0.15~30	-37.78	PASS
Band66	1.4MHz	16QAM	131979	1RB#5	30~1000	-60.15	PASS
Band66	1.4MHz	16QAM	131979	1RB#5	1000~3000	-39.80	PASS
Band66	1.4MHz	16QAM	131979	1RB#5	3000~20000	-27.05	PASS
Band66	1.4MHz	16QAM	131979	6RB#0	0.009~0.15	-45.75	PASS
Band66	1.4MHz	16QAM	131979	6RB#0	0.15~30	-37.22	PASS
Band66	1.4MHz	16QAM	131979	6RB#0	30~1000	-60.22	PASS
Band66	1.4MHz	16QAM	131979	6RB#0	1000~3000	-32.47	PASS
Band66	1.4MHz	16QAM	131979	6RB#0	3000~20000	-26.90	PASS
Band66	1.4MHz	QPSK	132322	1RB#0	0.009~0.15	-44.21	PASS
Band66	1.4MHz	QPSK	132322	1RB#0	0.15~30	-36.63	PASS
Band66	1.4MHz	QPSK	132322	1RB#0	30~1000	-60.20	PASS