

Test Graphs





Test Report No.: W7L-P24100002RF06

BAND EDGE

Test Result

Band	Channel	Frequency (MHz)	Result (dBm)	Limit(dBm)	Verdict
Band2	9262	1849.89	-28.28	-13	PASS
Band2	9538	1910.12	-28.26	-13	PASS

Test Graphs



CONDUCTED SPURIOUS EMISSION

Test Result

Band	Channel	Frequency Range (Mhz)	Frequency (dBm)	Result (dBm)	Limit (dBm)	Verdict
Band2	9262	30~1000MHz	879.14	-49.34	-13	PASS
Band2	9262	1000~10000MHz	3863.8	-41.25	-13	PASS
Band2	9262	10000~20000MHz	19979.5	-37.73	-13	PASS
Band2	9400	30~1000MHz	887.19	-49.19	-13	PASS
Band2	9400	1000~10000MHz	3795.85	-40.97	-13	PASS
Band2	9400	10000~20000MHz	19167	-37.78	-13	PASS
Band2	9538	30~1000MHz	903.49	-49.26	-13	PASS
Band2	9538	1000~10000MHz	3889.9	-41.33	-13	PASS
Band2	9538	10000~20000MHz	19331.5	-37.52	-13	PASS


Test Graphs





BUREAU
VERITAS

Test Report No.: W7L-P24100002RF06

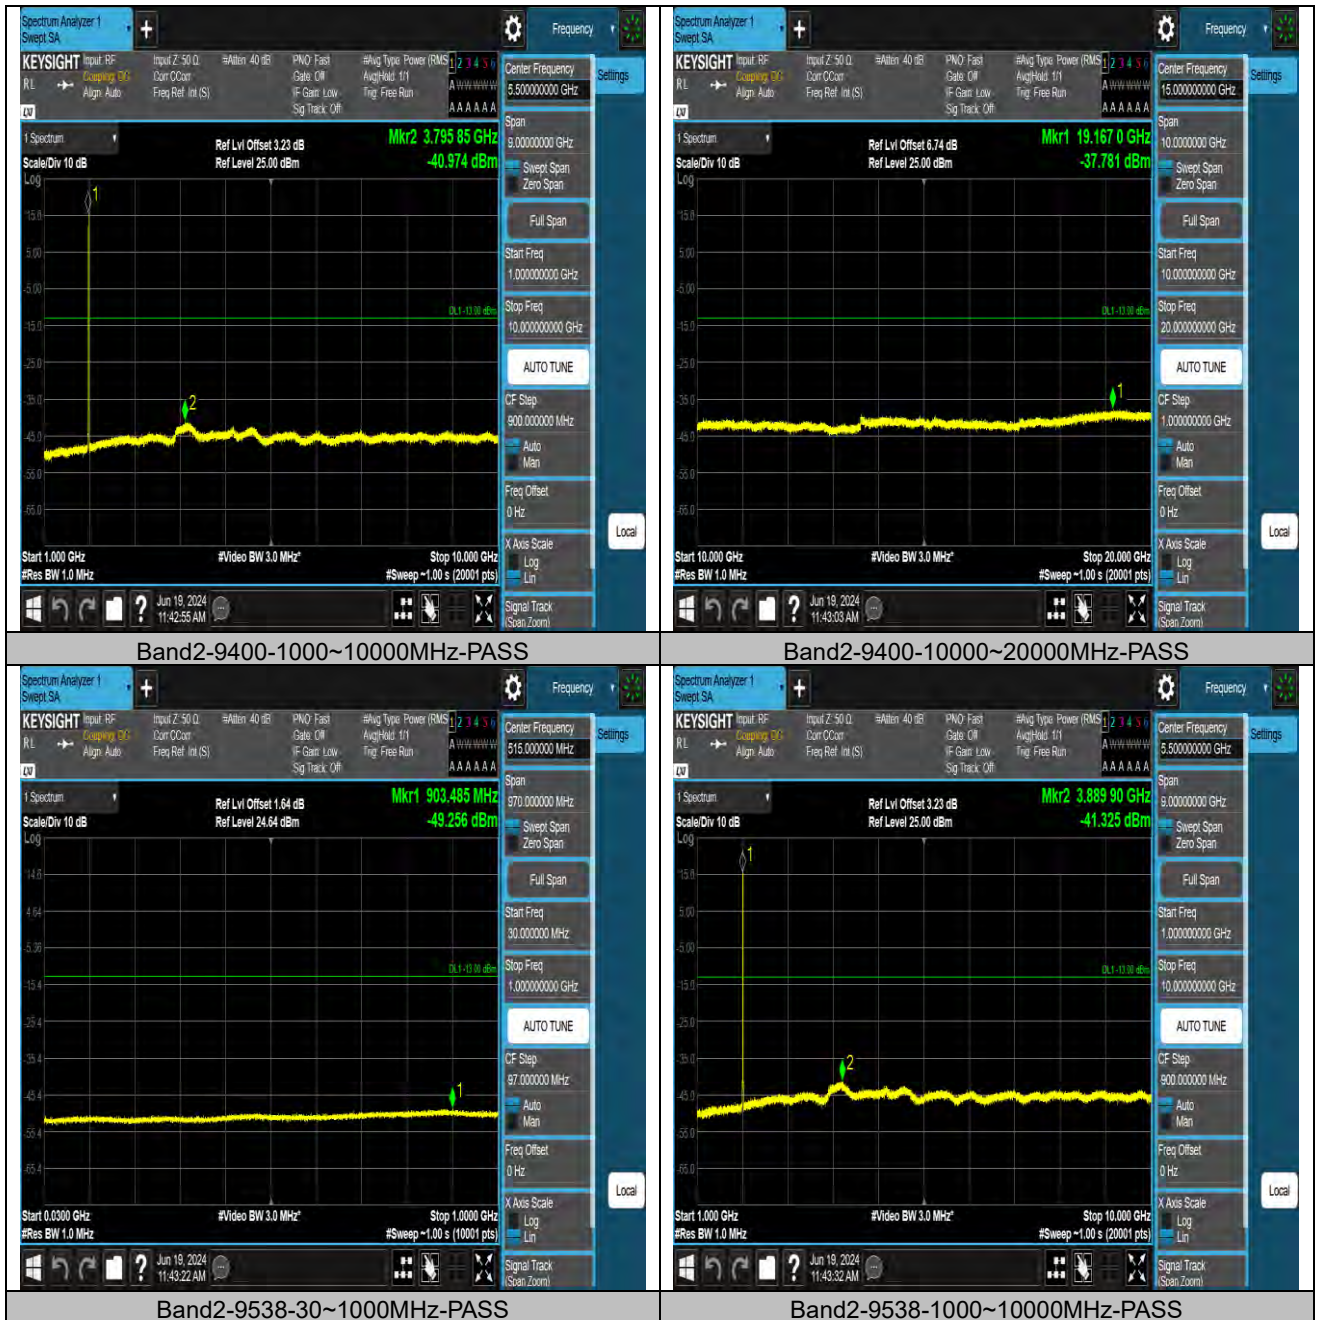

BV 7Layers Communications Technology
(Shenzhen) Co., Ltd


Room B37, Warehouse A5, No.3 Chiwan 4th Road,
Zhaoshang Street, Nanshan District Shenzhen,
Guangdong, People's Republic of China

Tel: +86 755 8869 6566
Fax: +86 755 8869 6577
Email: customerservice.sw@bureauveritas.com



BUREAU
VERITAS

Test Report No.: W7L-P24100002RF06

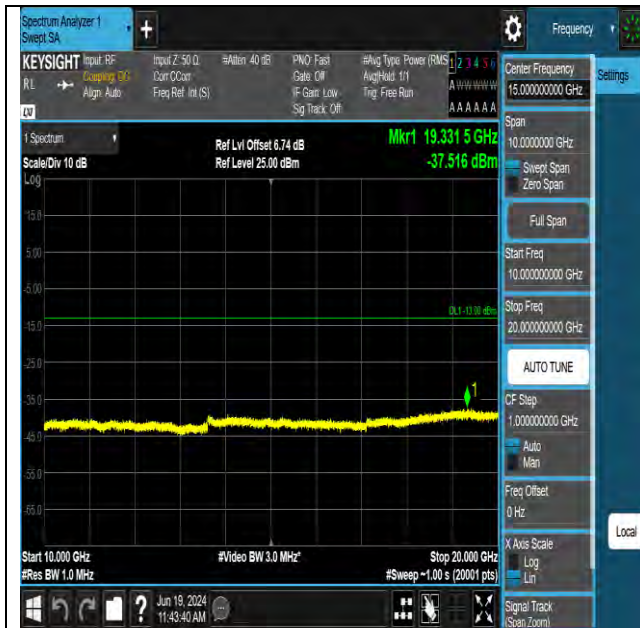

Band2-9538-10000~20000MHz-PASS

BV 7Layers Communications Technology
(Shenzhen) Co., Ltd

Room B37, Warehouse A5, No.3 Chiwan 4th Road,
Zhaoshang Street, Nanshan District Shenzhen,
Guangdong, People's Republic of China

Tel: +86 755 8869 6566
Fax: +86 755 8869 6577
Email: customerservice.sw@bureauveritas.com

FREQUENCY STABILITY

Test Result

Voltage									
Band	Channel	Voltage (Vdc)	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	FL (MHz)	FH (MHz)	Limit (MHz)	Verdict
Band2	9262	VN	NT	-800.00	-0.431872	1850.31655	---	1850-1910	PASS
Band2	9262	VL	NT	-40.00	-0.021594	1850.31636	---	1850-1910	PASS
Band2	9262	VH	NT	-500.00	-0.269920	1850.3161	---	1850-1910	PASS
Band2	9538	VN	NT	-10830.00	-5.677291	---	1909.67217	1850-1910	PASS
Band2	9538	VL	NT	-8210.00	-4.303837	---	1909.67364	1850-1910	PASS
Band2	9538	VH	NT	-12710.00	-6.662822	---	1909.66884	1850-1910	PASS

Temperature									
Band	Channel	Voltage (Vdc)	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	FL (MHz)	FH (MHz)	Limit (MHz)	Verdict
Band2	9262	NV	-30	-2570.00	-1.387389	1850.31373	---	1850-1910	PASS
Band2	9262	NV	-20	-500.00	-0.269920	1850.31625	---	1850-1910	PASS
Band2	9262	NV	-10	-3060.00	-1.651911	1850.31699	---	1850-1910	PASS
Band2	9262	NV	0	-3110.00	-1.678903	1850.31539	---	1850-1910	PASS
Band2	9262	NV	10	-1500.00	-0.809760	1850.31625	---	1850-1910	PASS
Band2	9262	NV	20	3810.00	2.056791	1850.31806	---	1850-1910	PASS
Band2	9262	NV	30	1550.00	0.836752	1850.32065	---	1850-1910	PASS
Band2	9262	NV	40	0.00	0.000000	1850.31585	---	1850-1910	PASS
Band2	9262	NV	50	-210.00	-0.113366	1850.31654	---	1850-1910	PASS
Band2	9538	NV	-30	-15280.00	-8.010065	---	1909.66422	1850-1910	PASS
Band2	9538	NV	-20	-12460.00	-6.531768	---	1909.66824	1850-1910	PASS
Band2	9538	NV	-10	-14890.00	-7.805620	---	1909.66266	1850-1910	PASS
Band2	9538	NV	0	-8850.00	-4.6393	---	1909.6	1850-1910	PASS



BUREAU
VERITAS

Test Report No.: W7L-P24100002RF06

				0	37		729	910	
Band2	9538	NV	10	-14110. 00	-7.3967 29	---	1909.6 6679	1850-1 910	PASS
Band2	9538	NV	20	-12410. 00	-6.5055 57	---	1909.6 6799	1850-1 910	PASS
Band2	9538	NV	30	-8380.0 0	-4.3929 54	---	1909.6 7287	1850-1 910	PASS
Band2	9538	NV	40	-11230. 00	-5.8869 78	---	1909.6 7392	1850-1 910	PASS
Band2	9538	NV	50	-15300. 00	-8.0205 49	---	1909.6 658	1850-1 910	PASS



Test Report No.: W7L-P24100002RF06


LTE BAND 2

PEAK-TO-AVERAGE RATIO(CCDF)

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dB)	Limit(dB)	Verdict
Band2	20MHz	QPSK	18700	1RB#0	5.42	13	PASS
Band2	20MHz	QPSK	18700	100RB#0	5.70	13	PASS
Band2	20MHz	QPSK	18900	1RB#0	5.43	13	PASS
Band2	20MHz	QPSK	18900	100RB#0	5.82	13	PASS
Band2	20MHz	QPSK	19100	1RB#0	5.47	13	PASS
Band2	20MHz	QPSK	19100	100RB#0	5.62	13	PASS

Test Graphs

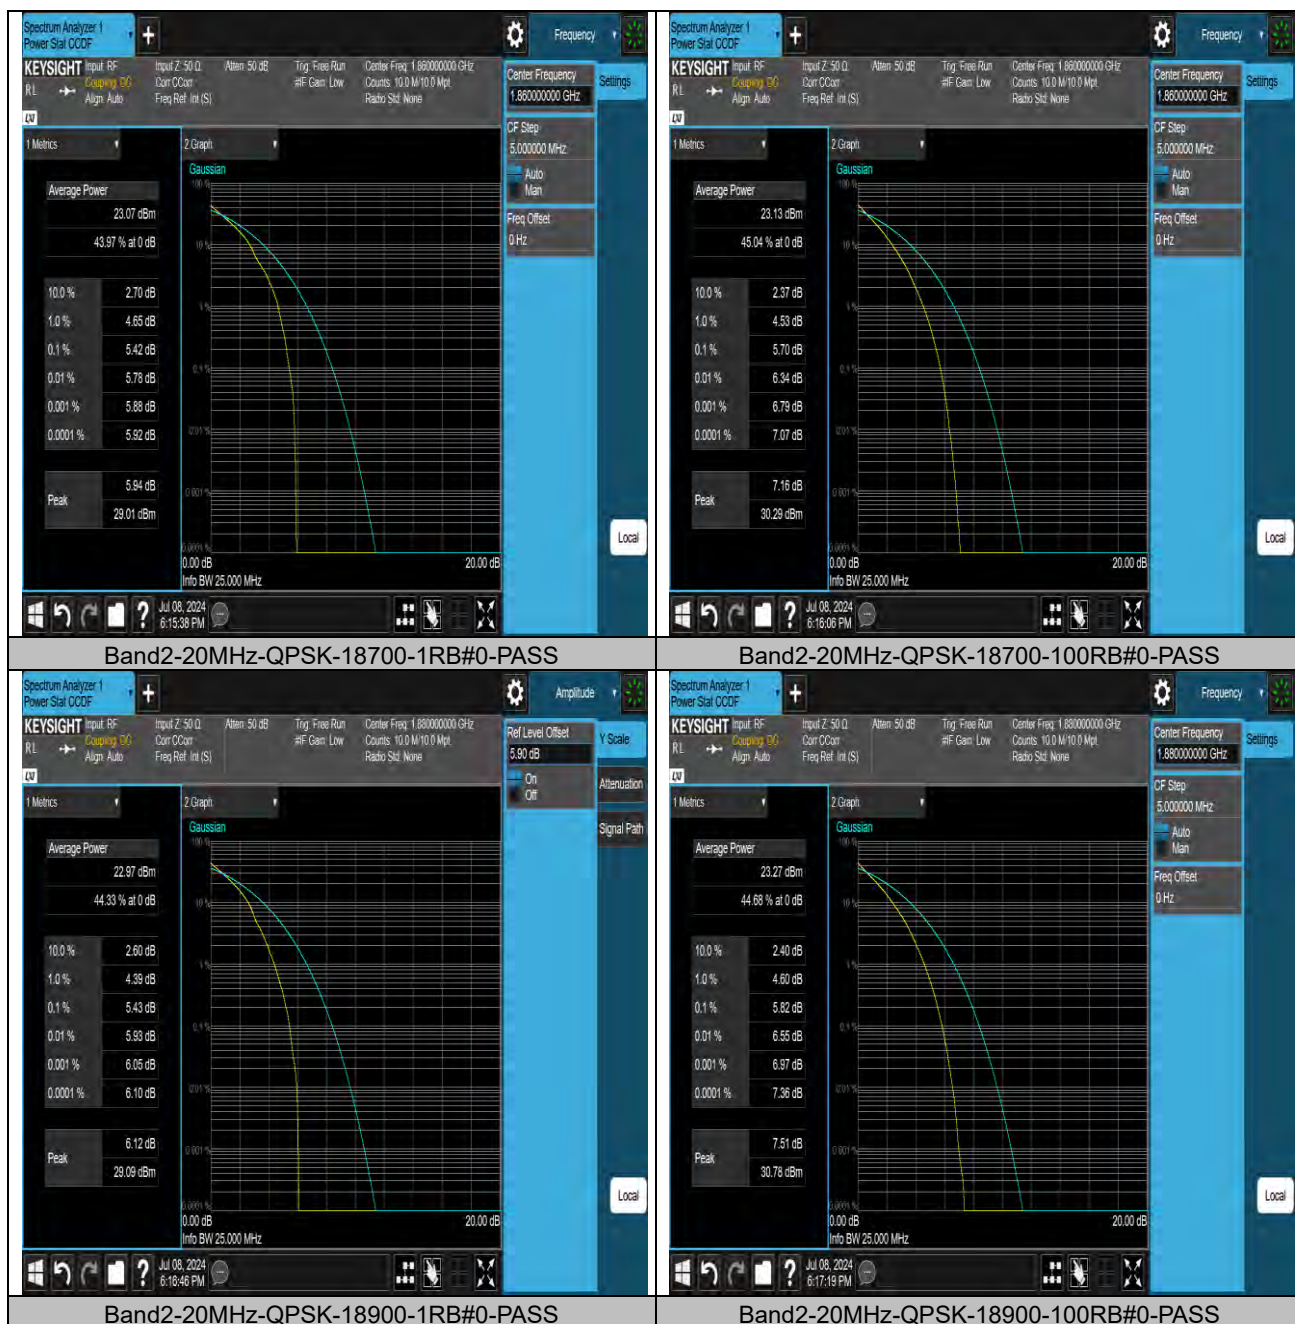



BUREAU
VERITAS

Test Report No.: W7L-P24100002RF06




26DB BANDWIDTH AND OCCUPIED BANDWIDTH

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Occupied Bandwidth (MHz)	26dB Bandwidth (MHz)	Verdict
Band2	1.4MHz	QPSK	18607	6RB#0	1.0886	1.286	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	1.0888	1.290	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	1.0970	1.268	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	1.0960	1.308	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	1.0939	1.291	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	1.0953	1.307	PASS
Band2	3MHz	QPSK	18615	15RB#0	2.6832	2.901	PASS
Band2	3MHz	QPSK	18900	15RB#0	2.6885	2.911	PASS
Band2	3MHz	QPSK	19185	15RB#0	2.6821	2.898	PASS
Band2	3MHz	16QAM	18615	15RB#0	2.6879	2.907	PASS
Band2	3MHz	16QAM	18900	15RB#0	2.6870	2.909	PASS
Band2	3MHz	16QAM	19185	15RB#0	2.6868	2.921	PASS
Band2	5MHz	QPSK	18625	25RB#0	4.5023	4.981	PASS
Band2	5MHz	QPSK	18900	25RB#0	4.5012	4.969	PASS
Band2	5MHz	QPSK	19175	25RB#0	4.5044	4.996	PASS
Band2	5MHz	16QAM	18625	25RB#0	4.5014	4.959	PASS
Band2	5MHz	16QAM	18900	25RB#0	4.5000	4.967	PASS
Band2	5MHz	16QAM	19175	25RB#0	4.5003	4.940	PASS
Band2	10MHz	QPSK	18650	50RB#0	9.0123	9.747	PASS
Band2	10MHz	QPSK	18900	50RB#0	8.9867	9.750	PASS
Band2	10MHz	QPSK	19150	50RB#0	8.9874	9.744	PASS
Band2	10MHz	16QAM	18650	50RB#0	8.9986	9.755	PASS
Band2	10MHz	16QAM	18900	50RB#0	8.9918	9.783	PASS
Band2	10MHz	16QAM	19150	50RB#0	8.9730	9.743	PASS
Band2	15MHz	QPSK	18675	75RB#0	13.478	14.72	PASS
Band2	15MHz	QPSK	18900	75RB#0	13.481	14.73	PASS
Band2	15MHz	QPSK	19125	75RB#0	13.447	14.59	PASS
Band2	15MHz	16QAM	18675	75RB#0	13.480	14.67	PASS
Band2	15MHz	16QAM	18900	75RB#0	13.468	14.63	PASS
Band2	15MHz	16QAM	19125	75RB#0	13.420	14.60	PASS
Band2	20MHz	QPSK	18700	100RB#0	17.968	19.26	PASS
Band2	20MHz	QPSK	18900	100RB#0	17.989	19.41	PASS
Band2	20MHz	QPSK	19100	100RB#0	17.925	19.31	PASS
Band2	20MHz	16QAM	18700	100RB#0	17.895	19.31	PASS
Band2	20MHz	16QAM	18900	100RB#0	17.957	19.33	PASS
Band2	20MHz	16QAM	19100	100RB#0	17.888	19.29	PASS



Test Graphs

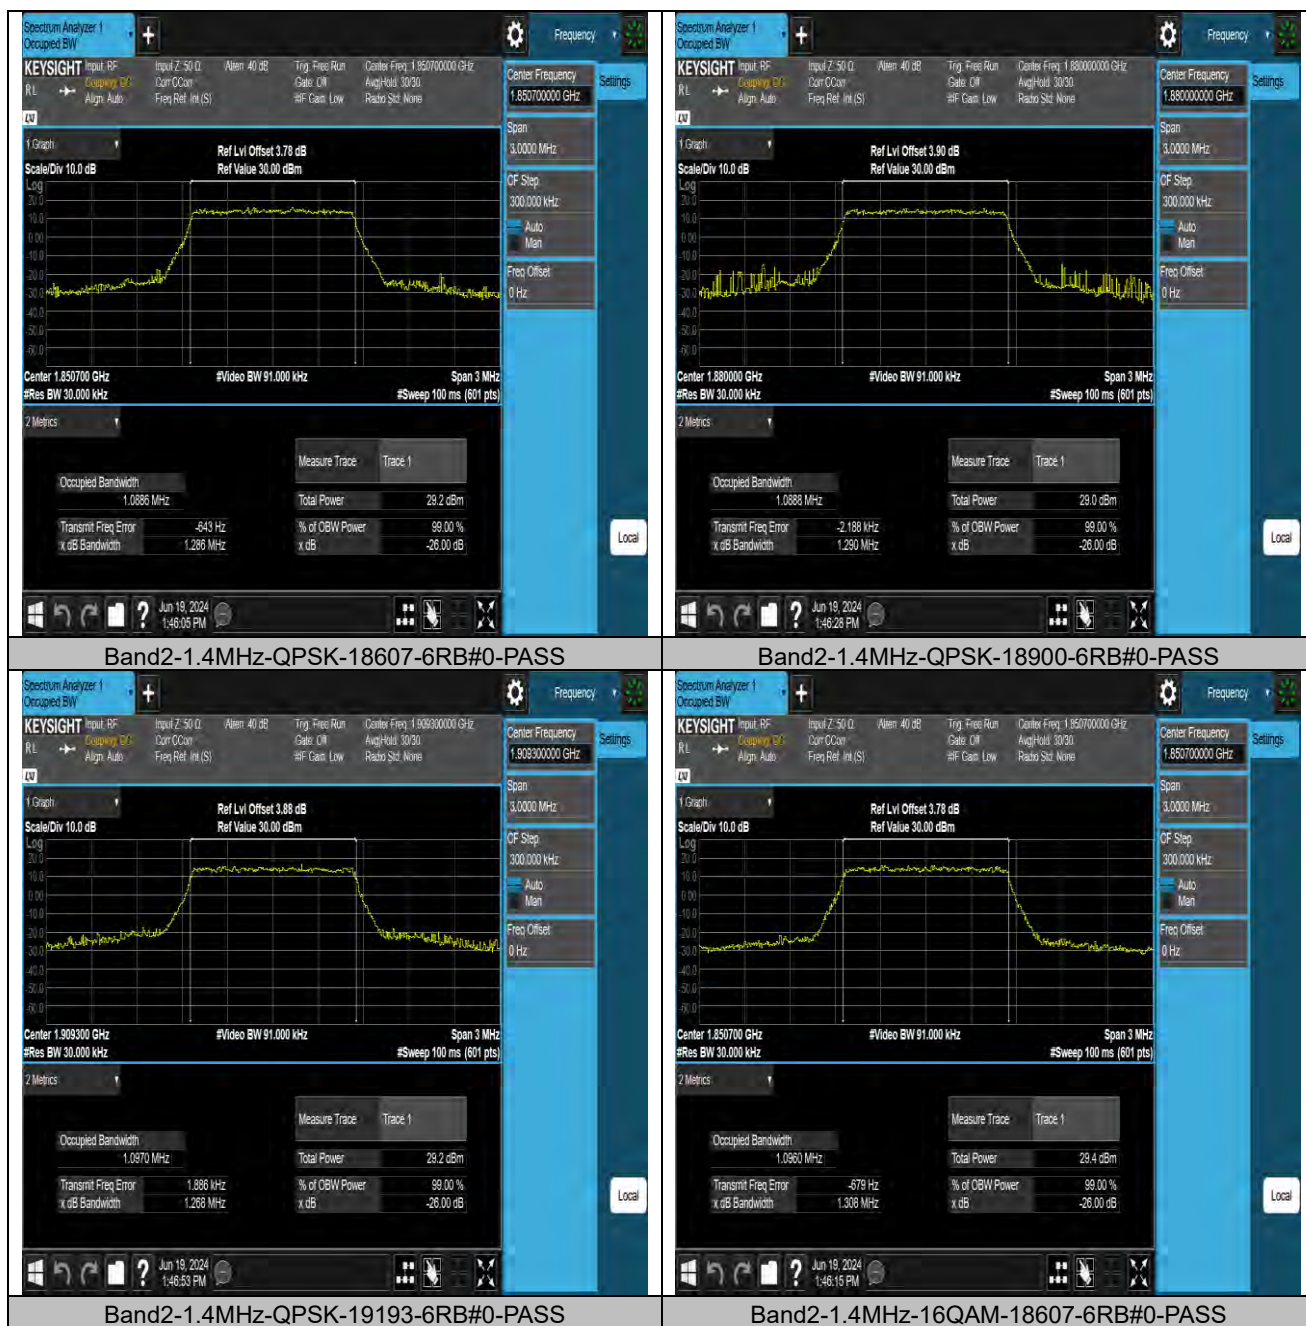



BUREAU
VERITAS

Test Report No.: W7L-P24100002RF06

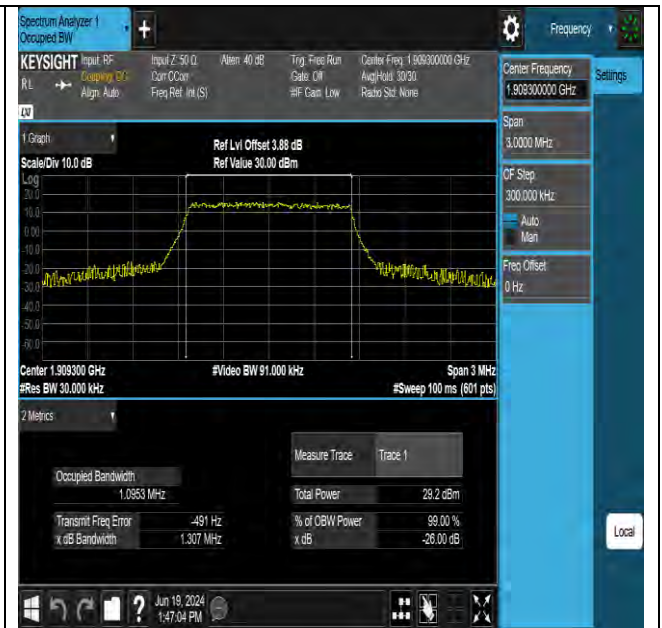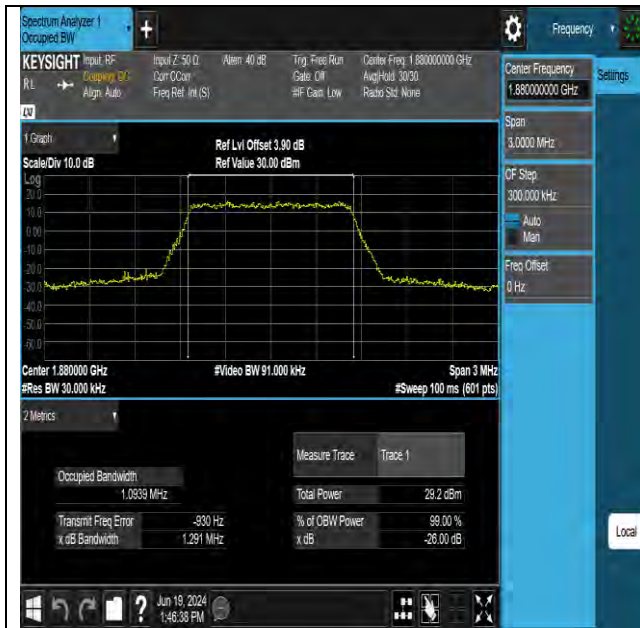

Band2-1.4MHz-16QAM-18900-6RB#0-PASS

Band2-1.4MHz-16QAM-19193-6RB#0-PASS




Band2-3MHz-QPSK-18615-15RB#0-PASS

Band2-3MHz-QPSK-18900-15RB#0-PASS



BUREAU
VERITAS

Test Report No.: W7L-P24100002RF06

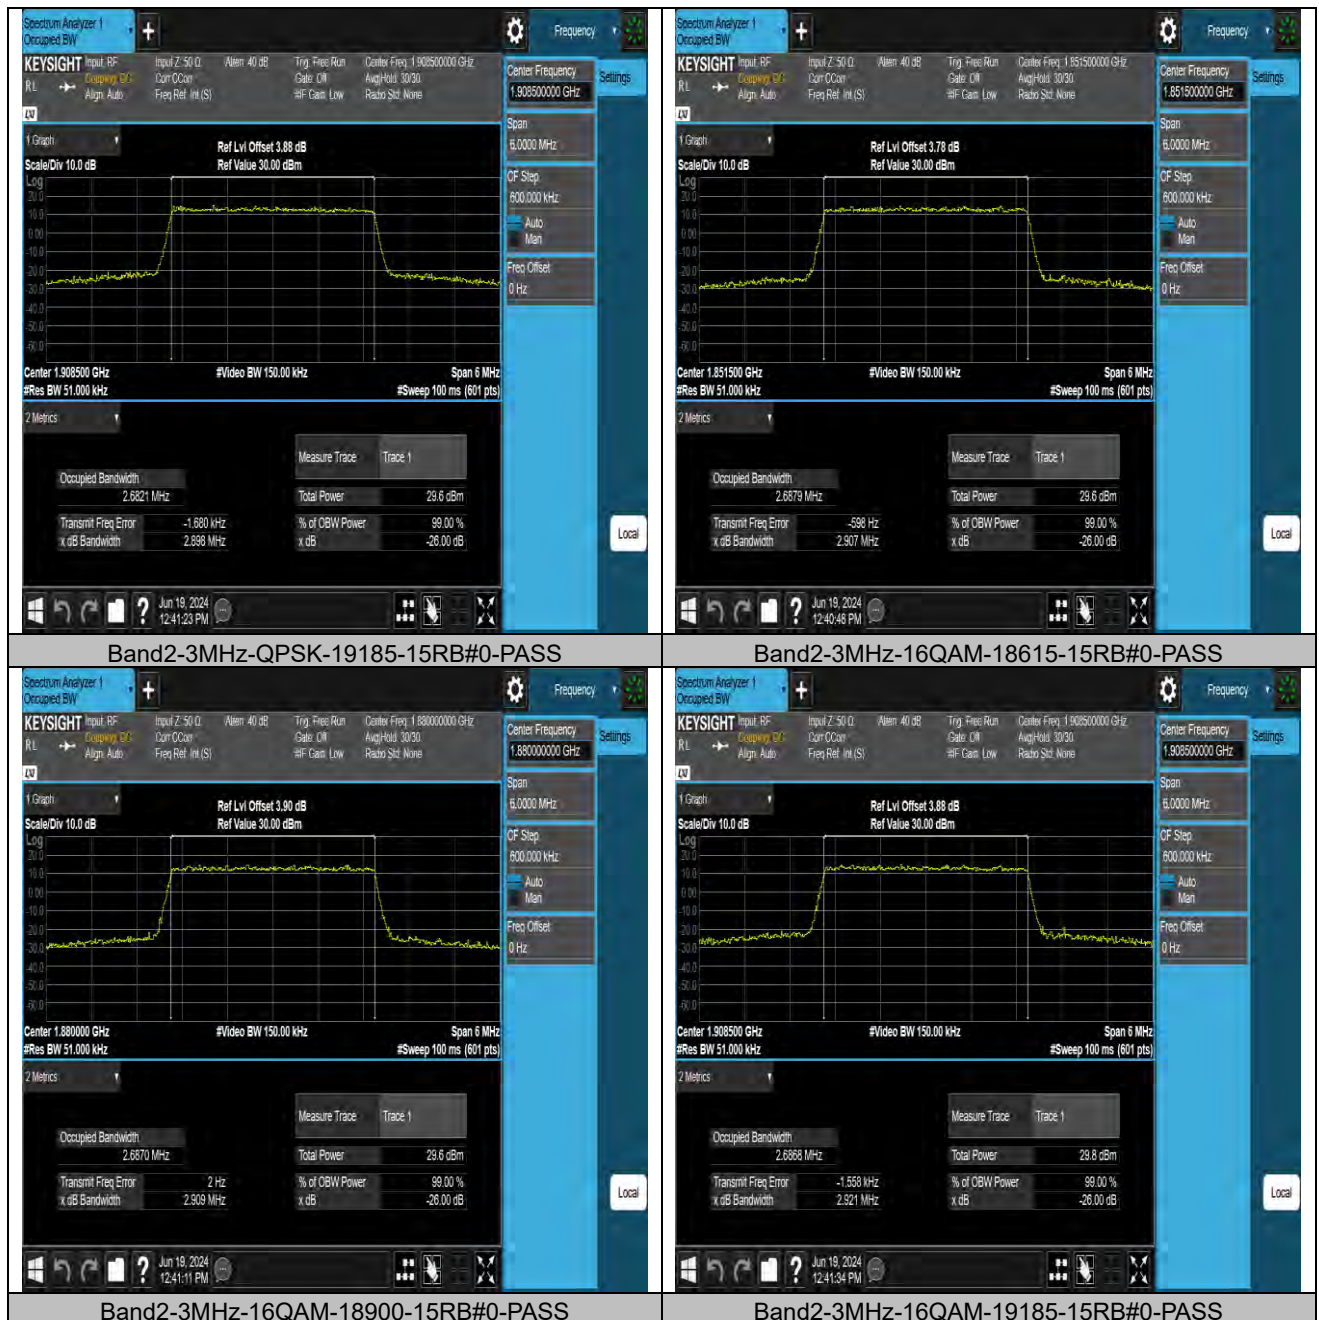

BV 7Layers Communications Technology
(Shenzhen) Co., Ltd


Room B37, Warehouse A5, No.3 Chiwan 4th Road,
Zhaoshang Street, Nanshan District Shenzhen,
Guangdong, People's Republic of China

Tel: +86 755 8869 6566
Fax: +86 755 8869 6577
Email: customerservice.sw@bureauveritas.com




BUREAU
VERITAS

Test Report No.: W7L-P24100002RF06

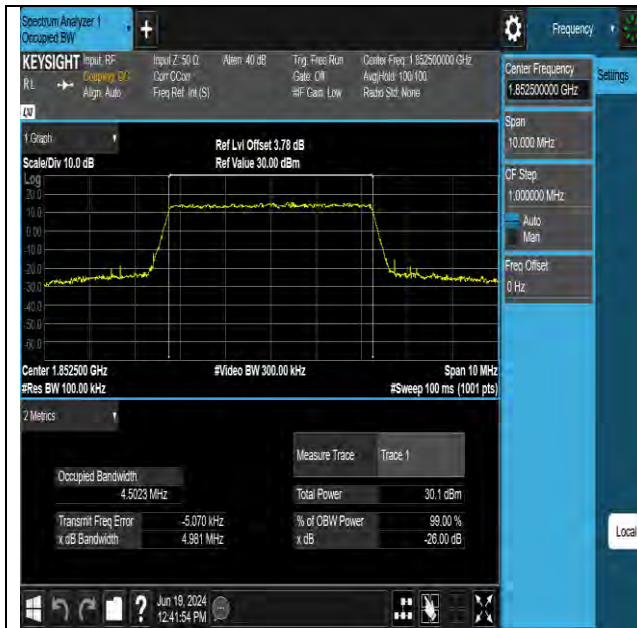


Band2-5MHz-QPSK-18625-25RB#0-PASS

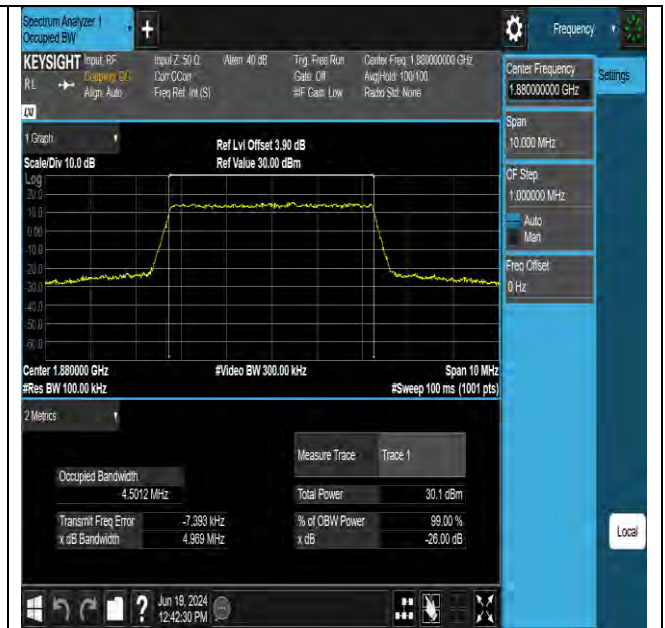

Band2-5MHz-QPSK-18900-25RB#0-PASS



Band2-5MHz-QPSK-19175-25RB#0-PASS

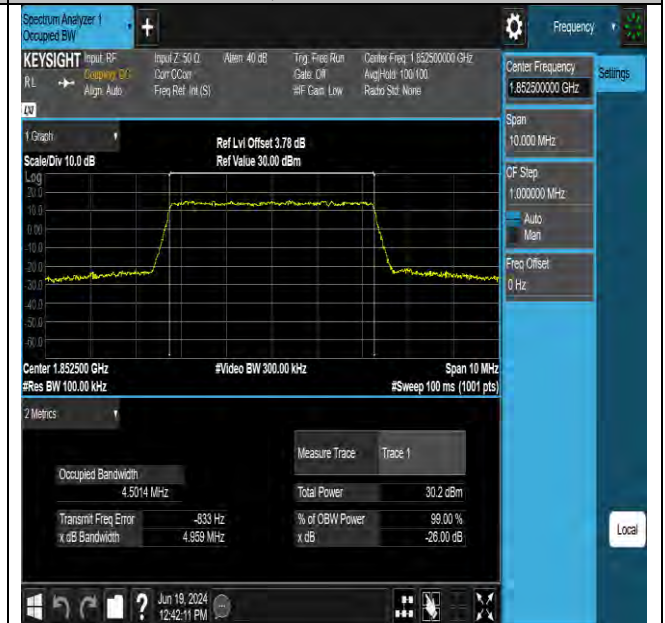

Band2-5MHz-16QAM-18625-25RB#0-PASS



BUREAU
VERITAS

Test Report No.: W7L-P24100002RF06



Band2-5MHz-16QAM-18900-25RB#0-PASS



Band2-5MHz-16QAM-19175-25RB#0-PASS



Band2-10MHz-QPSK-18650-50RB#0-PASS



Band2-10MHz-QPSK-18900-50RB#0-PASS




BUREAU
VERITAS

Test Report No.: W7L-P24100002RF06



Band2-10MHz-QPSK-19150-50RB#0-PASS

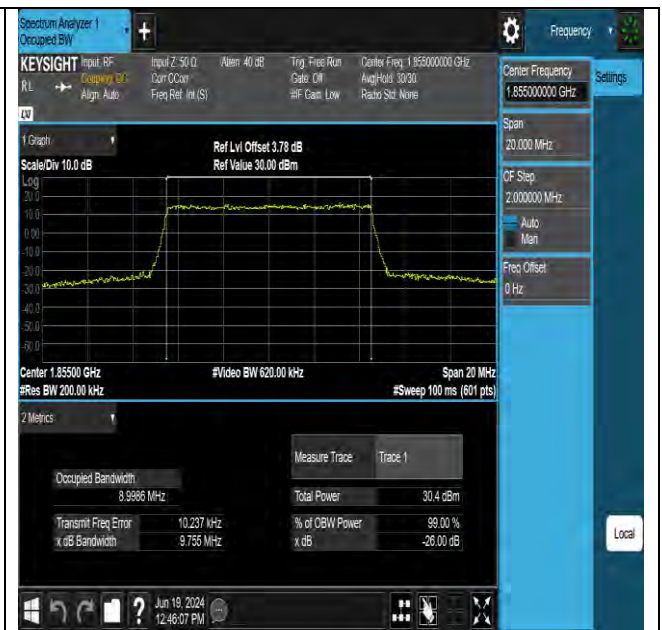

Band2-10MHz-16QAM-18650-50RB#0-PASS



Band2-10MHz-16QAM-18900-50RB#0-PASS



Band2-10MHz-16QAM-19150-50RB#0-PASS




BUREAU
VERITAS

Test Report No.: W7L-P24100002RF06




Band2-15MHz-QPSK-18675-75RB#0-PASS

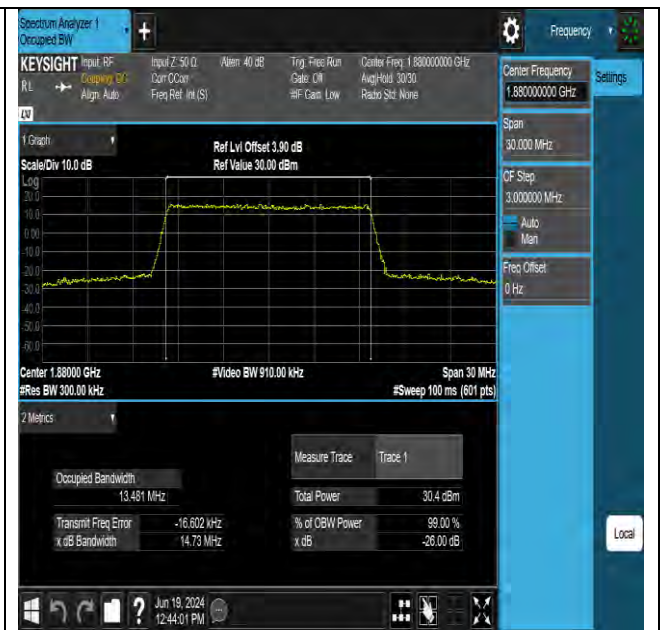

Band2-15MHz-QPSK-18900-75RB#0-PASS



Band2-15MHz-QPSK-19125-75RB#0-PASS

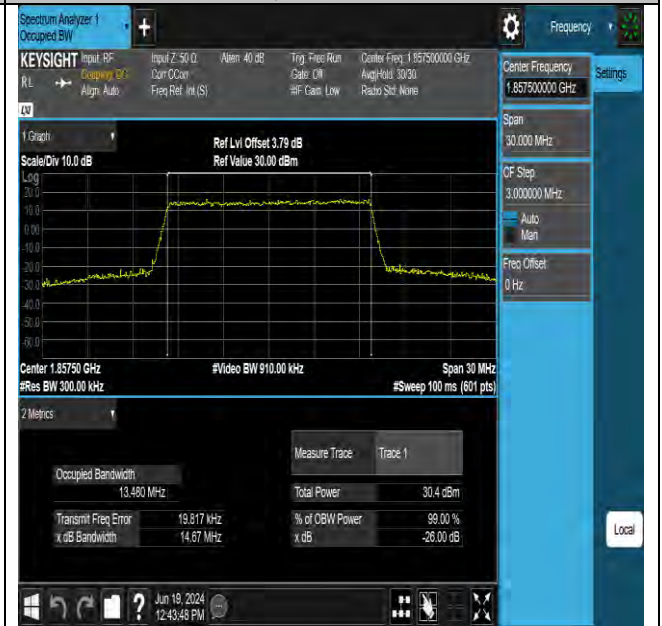

Band2-15MHz-16QAM-18675-75RB#0-PASS



BUREAU
VERITAS

Test Report No.: W7L-P24100002RF06



Band2-15MHz-16QAM-18900-75RB#0-PASS



Band2-15MHz-16QAM-19125-75RB#0-PASS



Band2-20MHz-QPSK-18700-100RB#0-PASS



Band2-20MHz-QPSK-18900-100RB#0-PASS



BUREAU
VERITAS

Test Report No.: W7L-P24100002RF06



Band2-20MHz-QPSK-19100-100RB#0-PASS



Band2-20MHz-16QAM-18700-100RB#0-PASS



Band2-20MHz-16QAM-18900-100RB#0-PASS



Band2-20MHz-16QAM-19100-100RB#0-PASS

BAND EDGE

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dBm)	Verdict
Band2	1.4MHz	QPSK	18607	1RB#0	-30.39	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	-30.85	PASS
Band2	1.4MHz	QPSK	19193	1RB#5	-27.60	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	-29.80	PASS
Band2	1.4MHz	16QAM	18607	1RB#0	-26.44	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	-28.64	PASS
Band2	1.4MHz	16QAM	19193	1RB#5	-28.67	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	-29.10	PASS
Band2	3MHz	QPSK	18615	1RB#0	-27.87	PASS
Band2	3MHz	QPSK	18615	15RB#0	-27.11	PASS
Band2	3MHz	QPSK	19185	1RB#14	-27.21	PASS
Band2	3MHz	QPSK	19185	15RB#0	-25.33	PASS
Band2	3MHz	16QAM	18615	1RB#0	-27.69	PASS
Band2	3MHz	16QAM	18615	15RB#0	-27.32	PASS
Band2	3MHz	16QAM	19185	1RB#14	-26.65	PASS
Band2	3MHz	16QAM	19185	15RB#0	-26.37	PASS
Band2	5MHz	QPSK	18625	1RB#0	-30.37	PASS
Band2	5MHz	QPSK	18625	25RB#0	-27.50	PASS
Band2	5MHz	QPSK	19175	1RB#24	-28.40	PASS
Band2	5MHz	QPSK	19175	25RB#0	-26.06	PASS
Band2	5MHz	16QAM	18625	1RB#0	-29.29	PASS
Band2	5MHz	16QAM	18625	25RB#0	-27.80	PASS
Band2	5MHz	16QAM	19175	1RB#24	-26.80	PASS
Band2	5MHz	16QAM	19175	25RB#0	-26.99	PASS
Band2	10MHz	QPSK	18650	1RB#0	-37.54	PASS
Band2	10MHz	QPSK	18650	50RB#0	-29.98	PASS
Band2	10MHz	QPSK	19150	1RB#49	-36.30	PASS
Band2	10MHz	QPSK	19150	50RB#0	-28.82	PASS
Band2	10MHz	16QAM	18650	1RB#0	-36.61	PASS
Band2	10MHz	16QAM	18650	50RB#0	-30.19	PASS
Band2	10MHz	16QAM	19150	1RB#49	-36.60	PASS
Band2	10MHz	16QAM	19150	50RB#0	-30.27	PASS
Band2	15MHz	QPSK	18675	1RB#0	-41.84	PASS
Band2	15MHz	QPSK	18675	75RB#0	-30.50	PASS
Band2	15MHz	QPSK	19125	1RB#74	-41.23	PASS
Band2	15MHz	QPSK	19125	75RB#0	-30.11	PASS
Band2	15MHz	16QAM	18675	1RB#0	-41.76	PASS
Band2	15MHz	16QAM	18675	75RB#0	-30.91	PASS
Band2	15MHz	16QAM	19125	1RB#74	-41.13	PASS
Band2	15MHz	16QAM	19125	75RB#0	-30.97	PASS
Band2	20MHz	QPSK	18700	1RB#0	-42.32	PASS
Band2	20MHz	QPSK	18700	100RB#0	-32.61	PASS
Band2	20MHz	QPSK	19100	1RB#99	-42.16	PASS




BUREAU
VERITAS

Test Report No.: W7L-P24100002RF06

Band2	20MHz	QPSK	19100	100RB#0	-32.34	PASS
Band2	20MHz	16QAM	18700	1RB#0	-42.30	PASS
Band2	20MHz	16QAM	18700	100RB#0	-33.42	PASS
Band2	20MHz	16QAM	19100	1RB#99	-41.98	PASS
Band2	20MHz	16QAM	19100	100RB#0	-33.53	PASS


Test Graphs

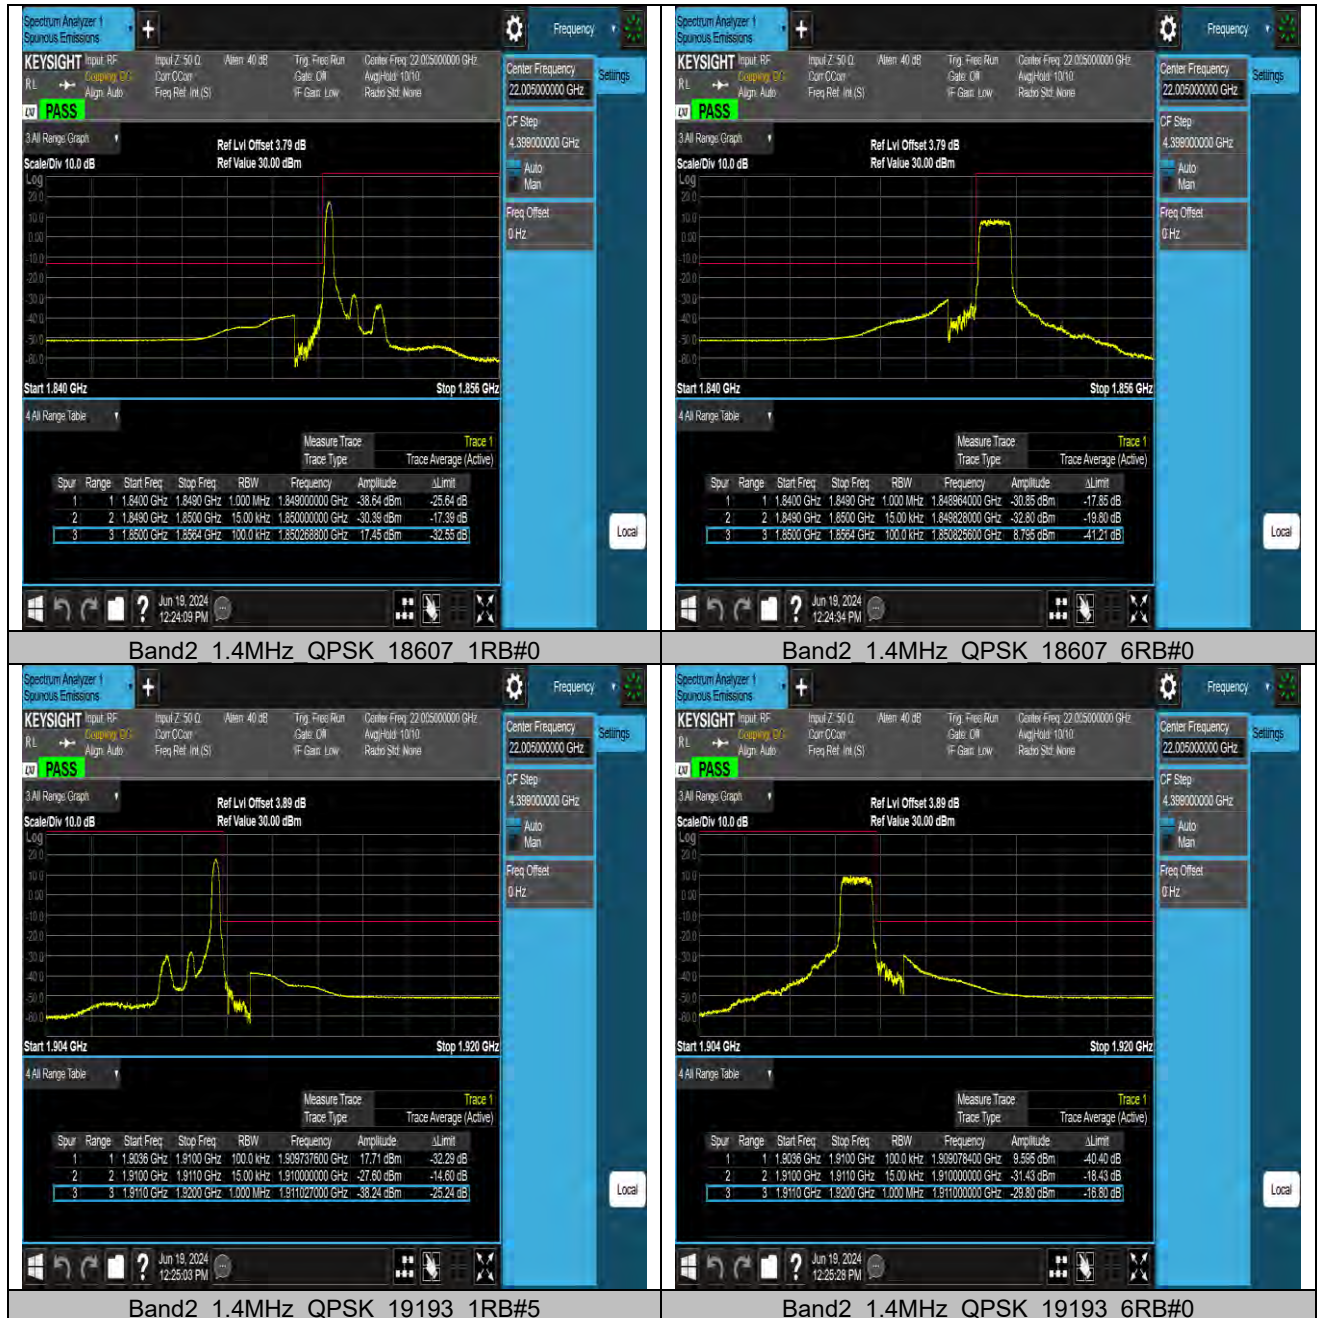



BUREAU
VERITAS


Test Report No.: W7L-P24100002RF06

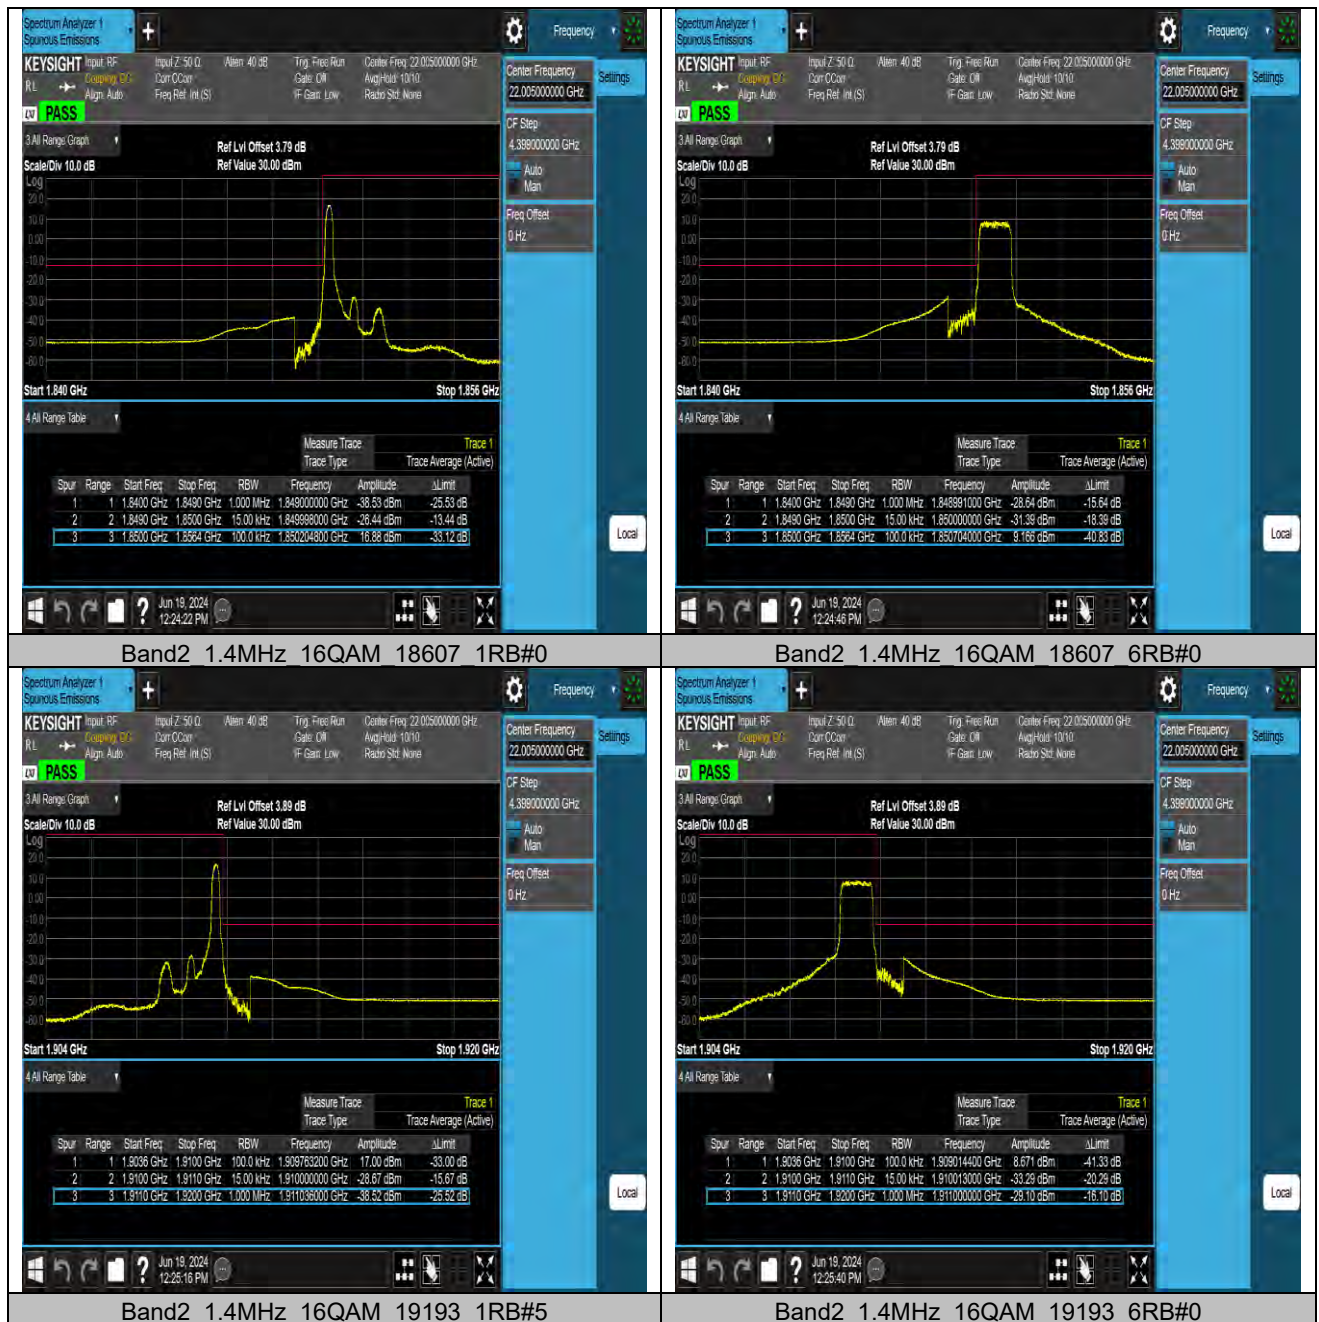



BUREAU
VERITAS


Test Report No.: W7L-P24100002RF06

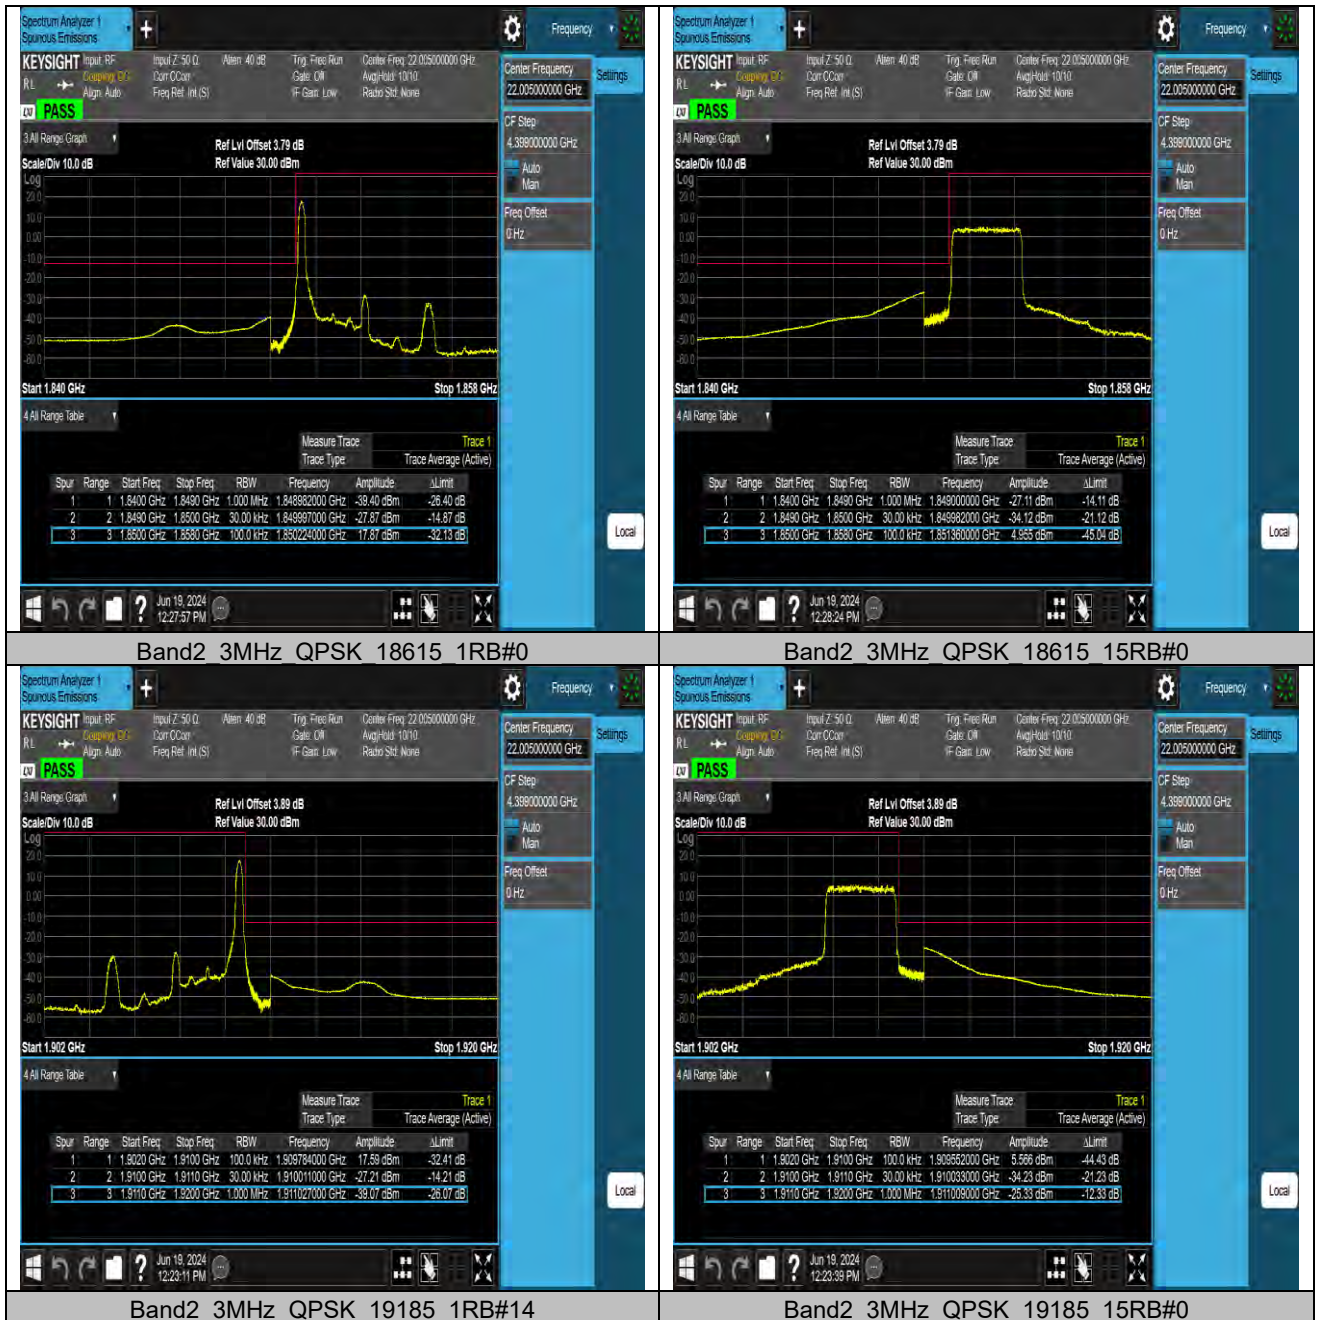



BUREAU
VERITAS


Test Report No.: W7L-P24100002RF06

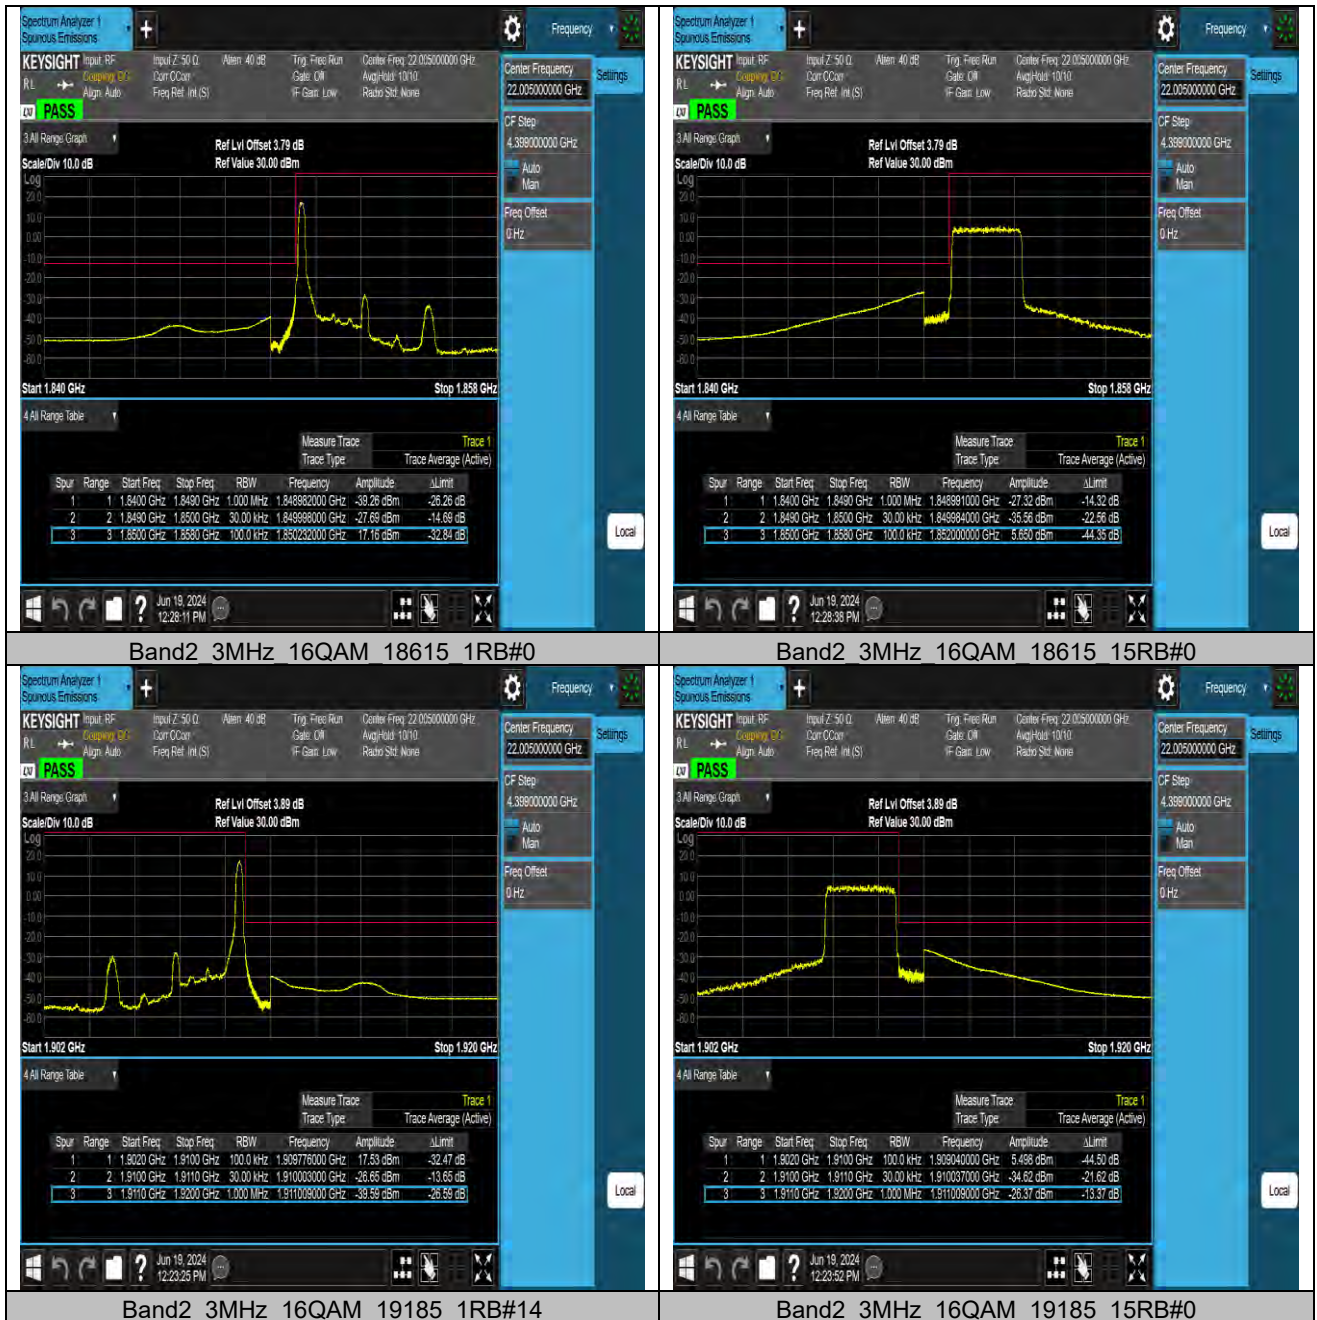



BUREAU
VERITAS


Test Report No.: W7L-P24100002RF06

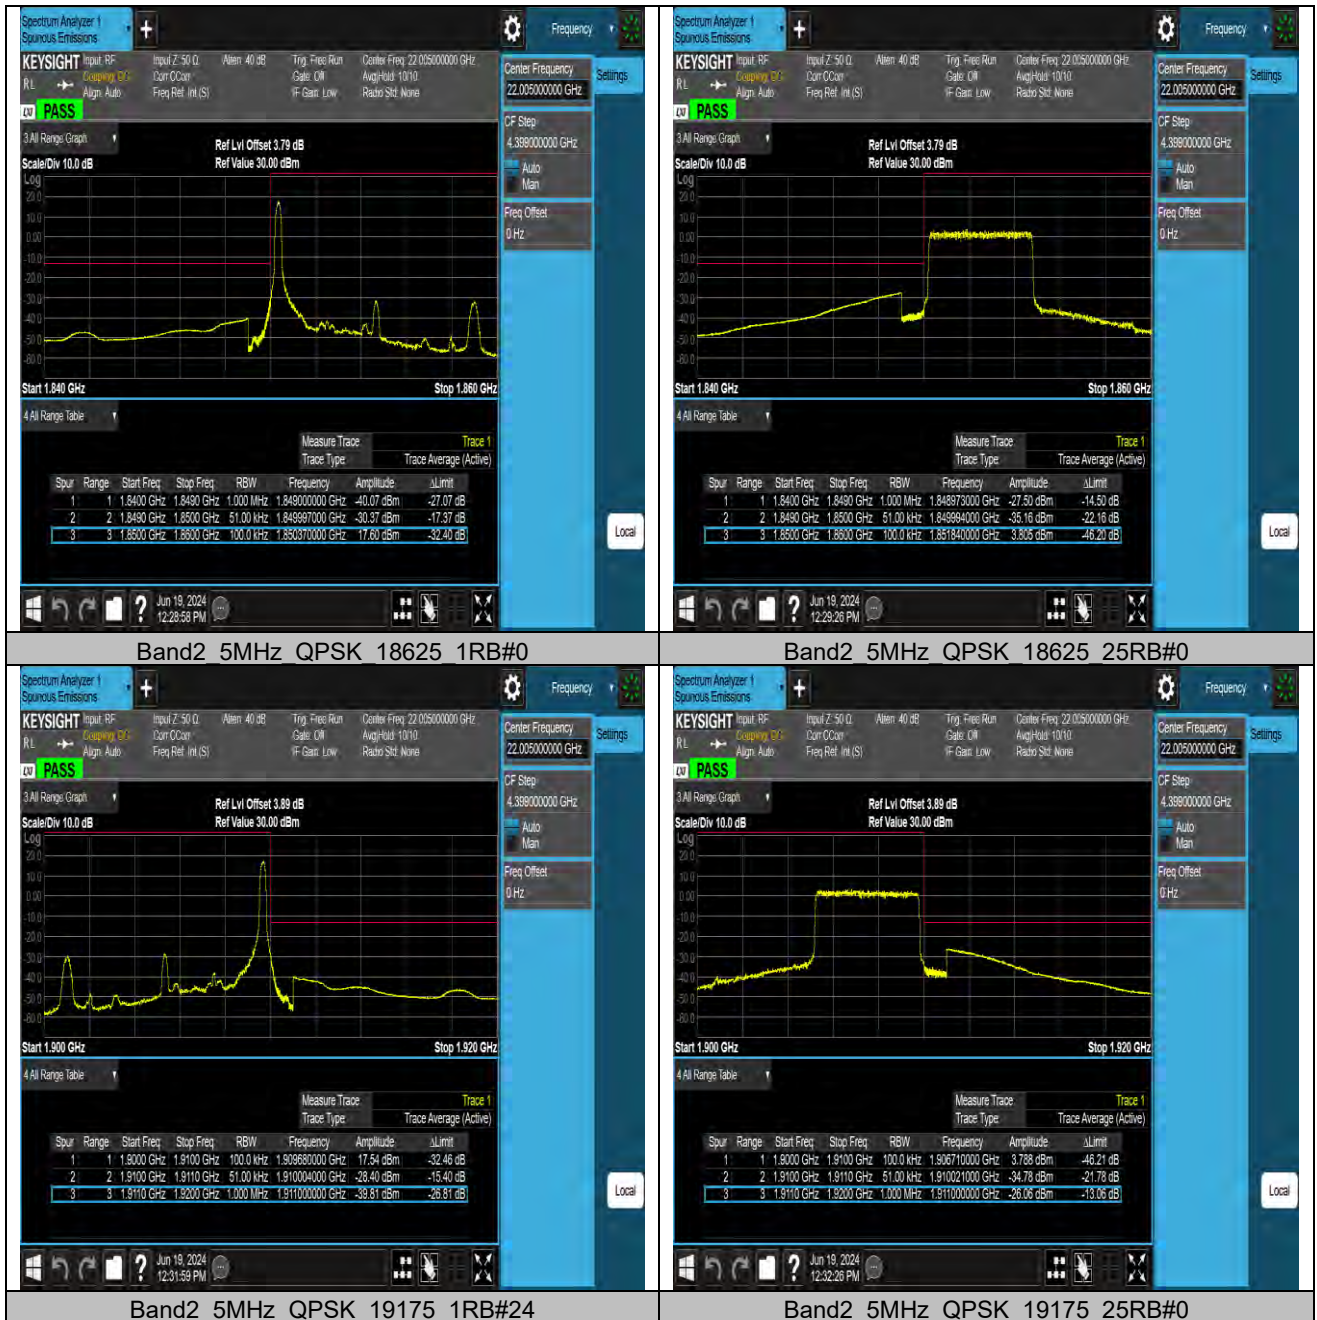



BUREAU
VERITAS


Test Report No.: W7L-P24100002RF06

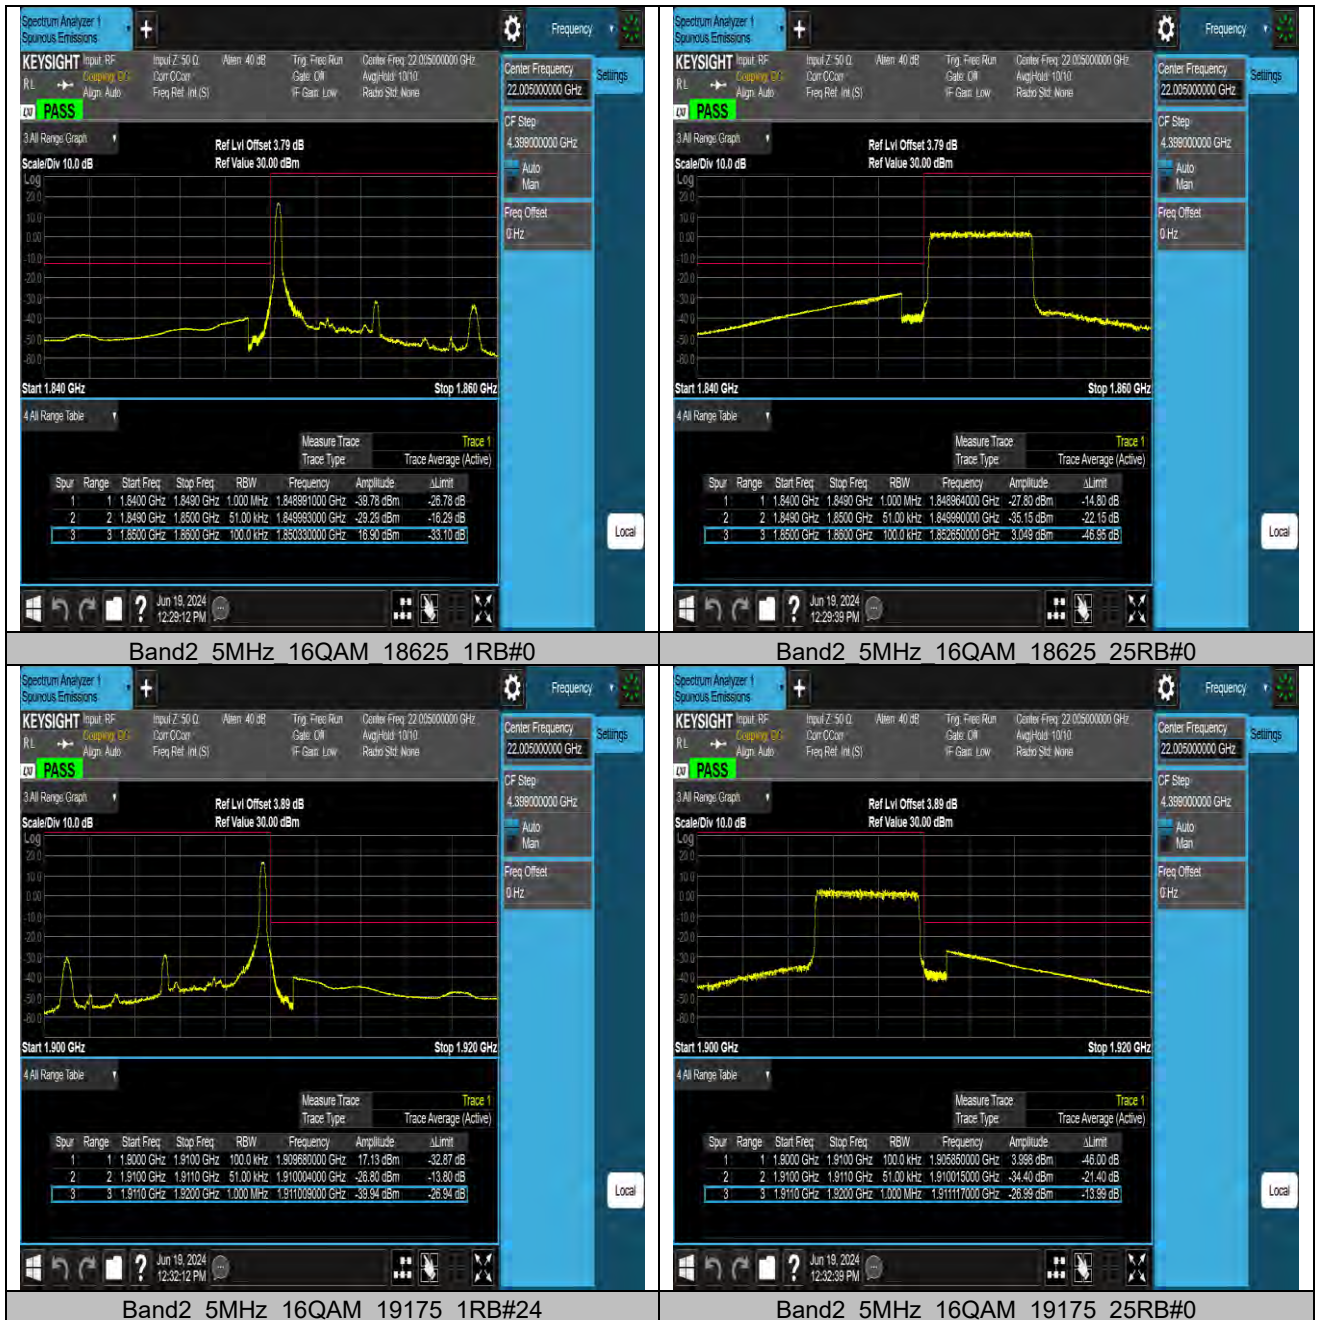



BUREAU
VERITAS


Test Report No.: W7L-P24100002RF06

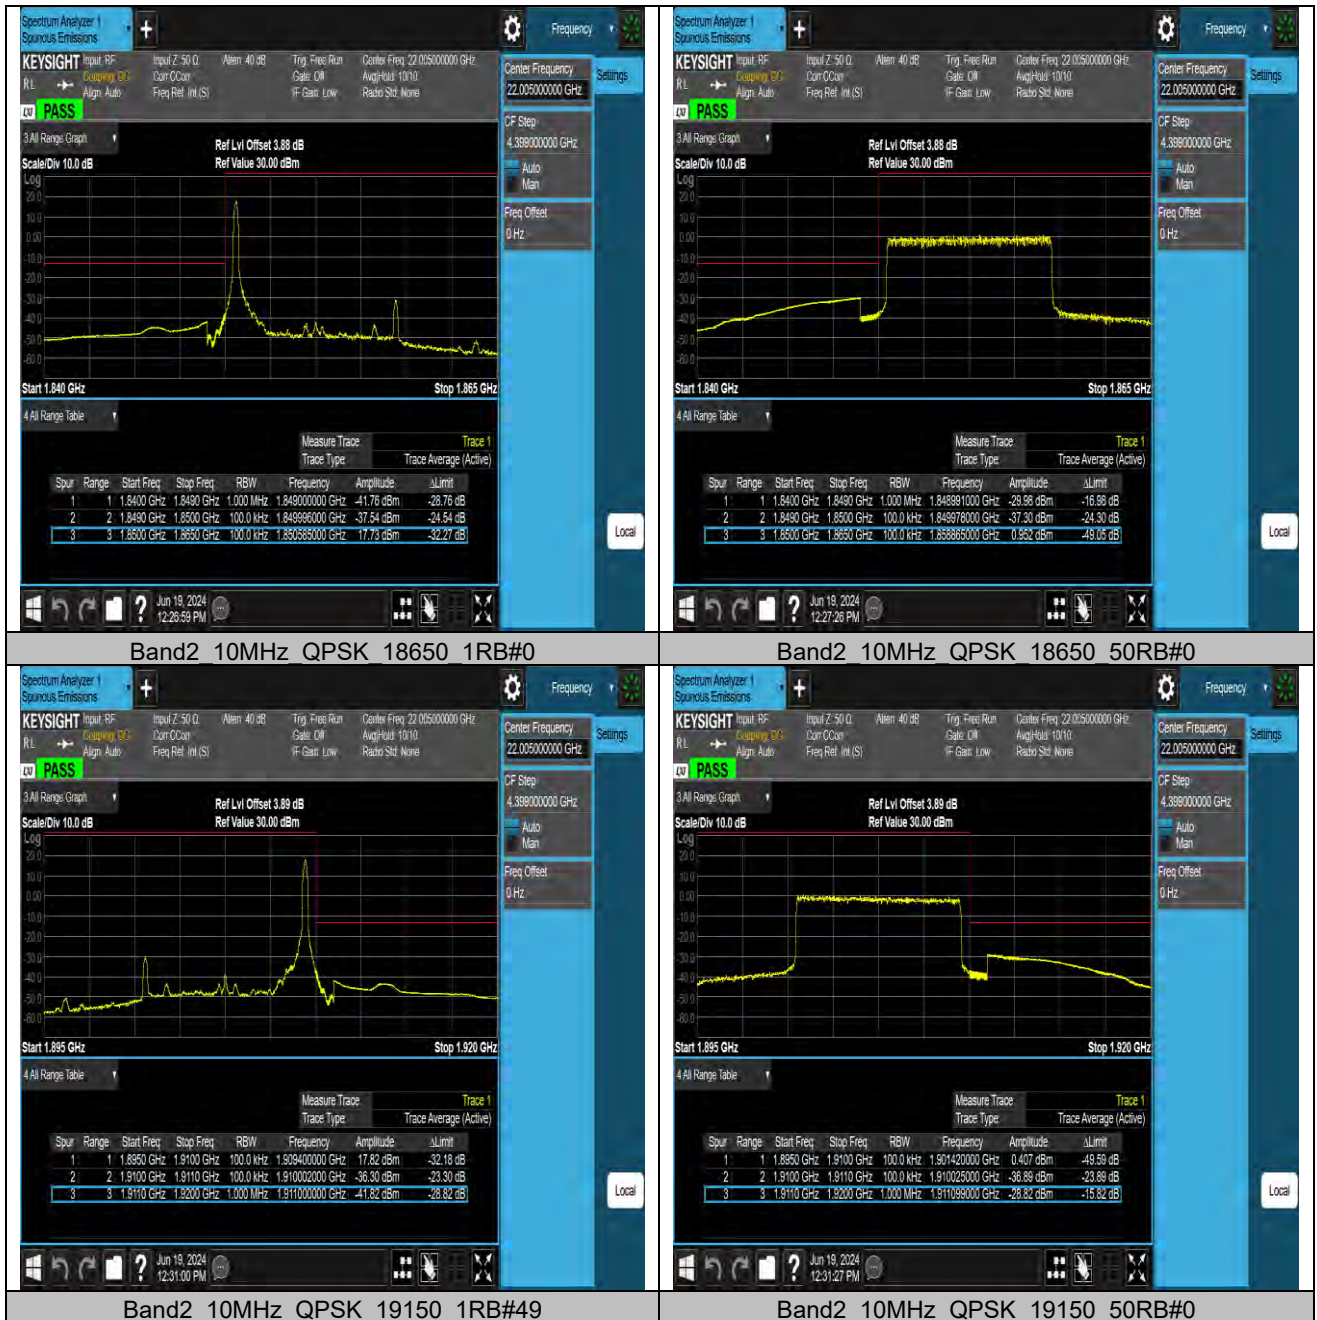



BUREAU
VERITAS


Test Report No.: W7L-P24100002RF06

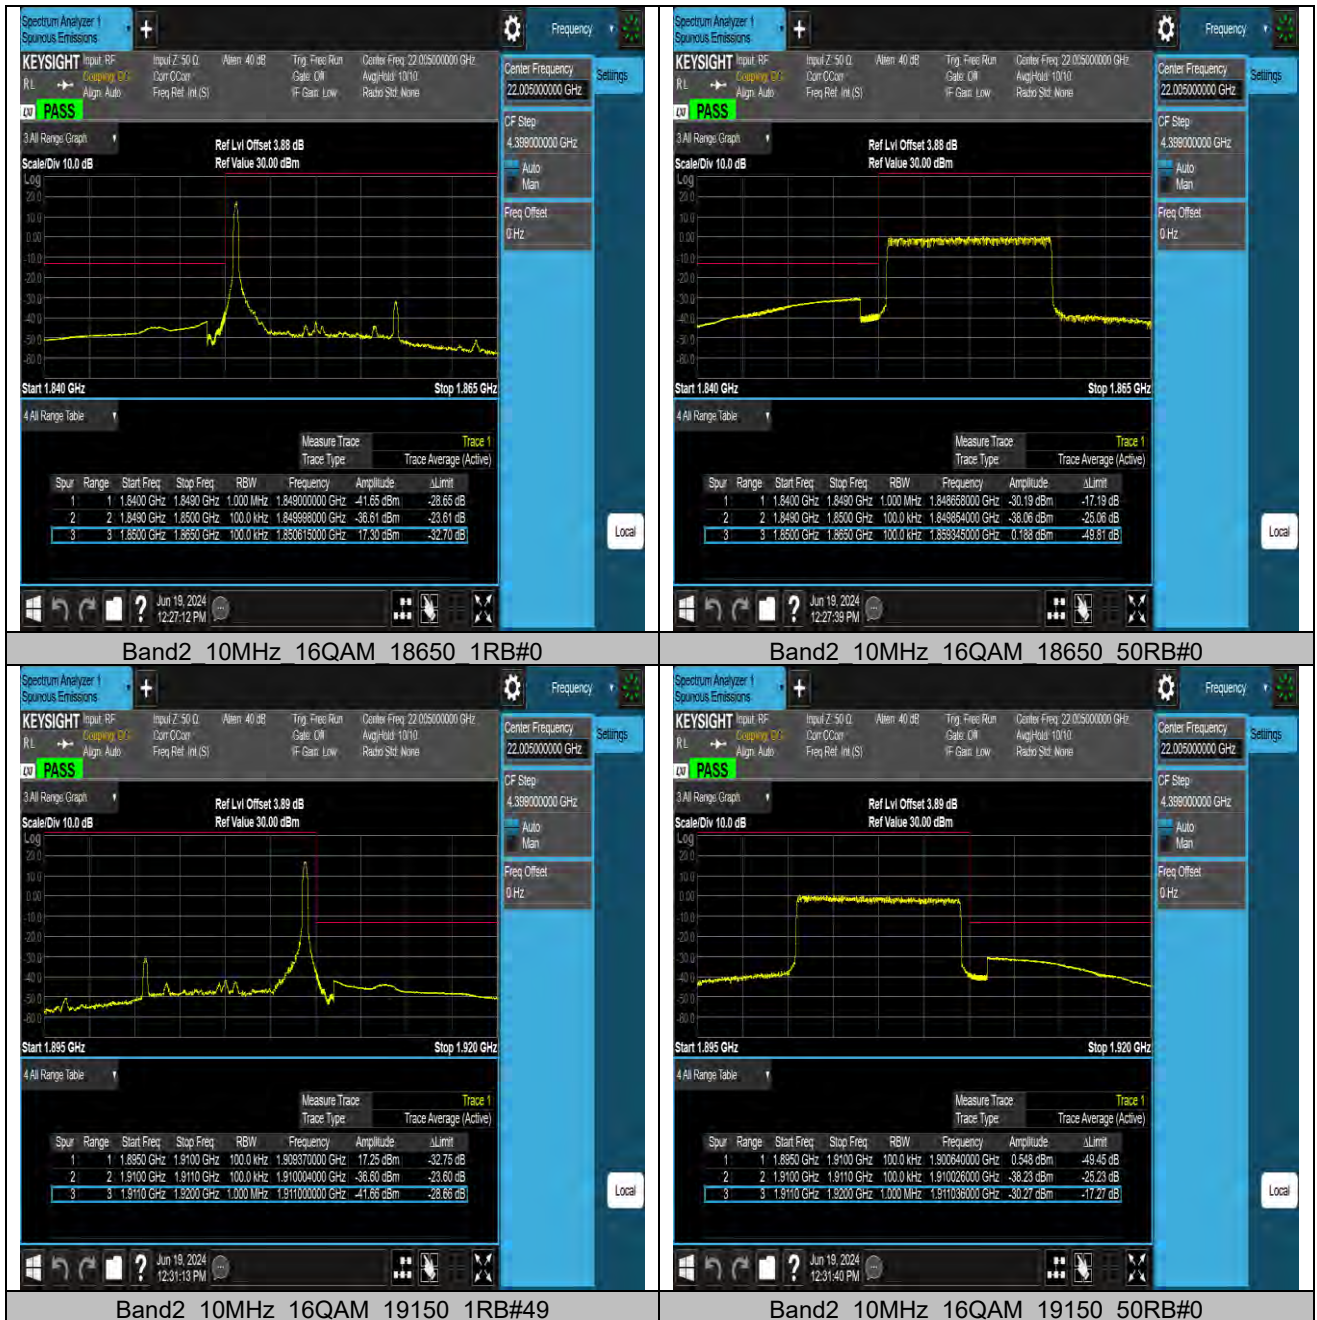



BUREAU
VERITAS


Test Report No.: W7L-P24100002RF06

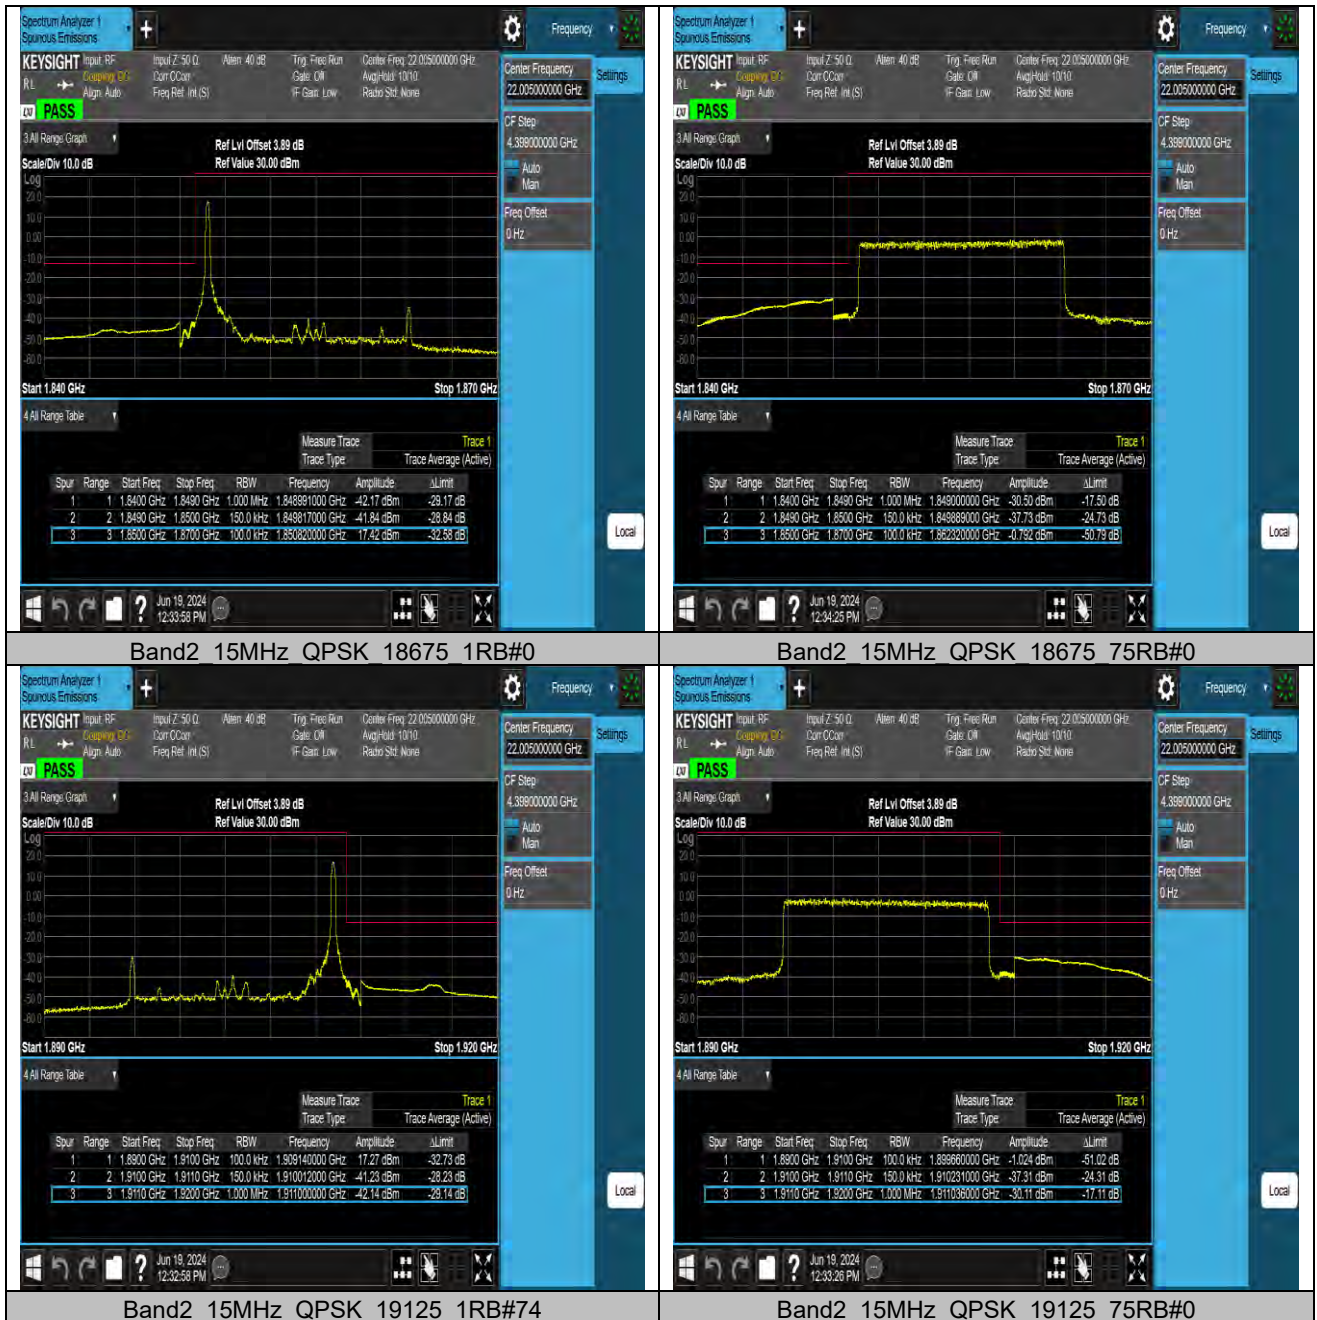



BUREAU
VERITAS

Test Report No.: W7L-P24100002RF06

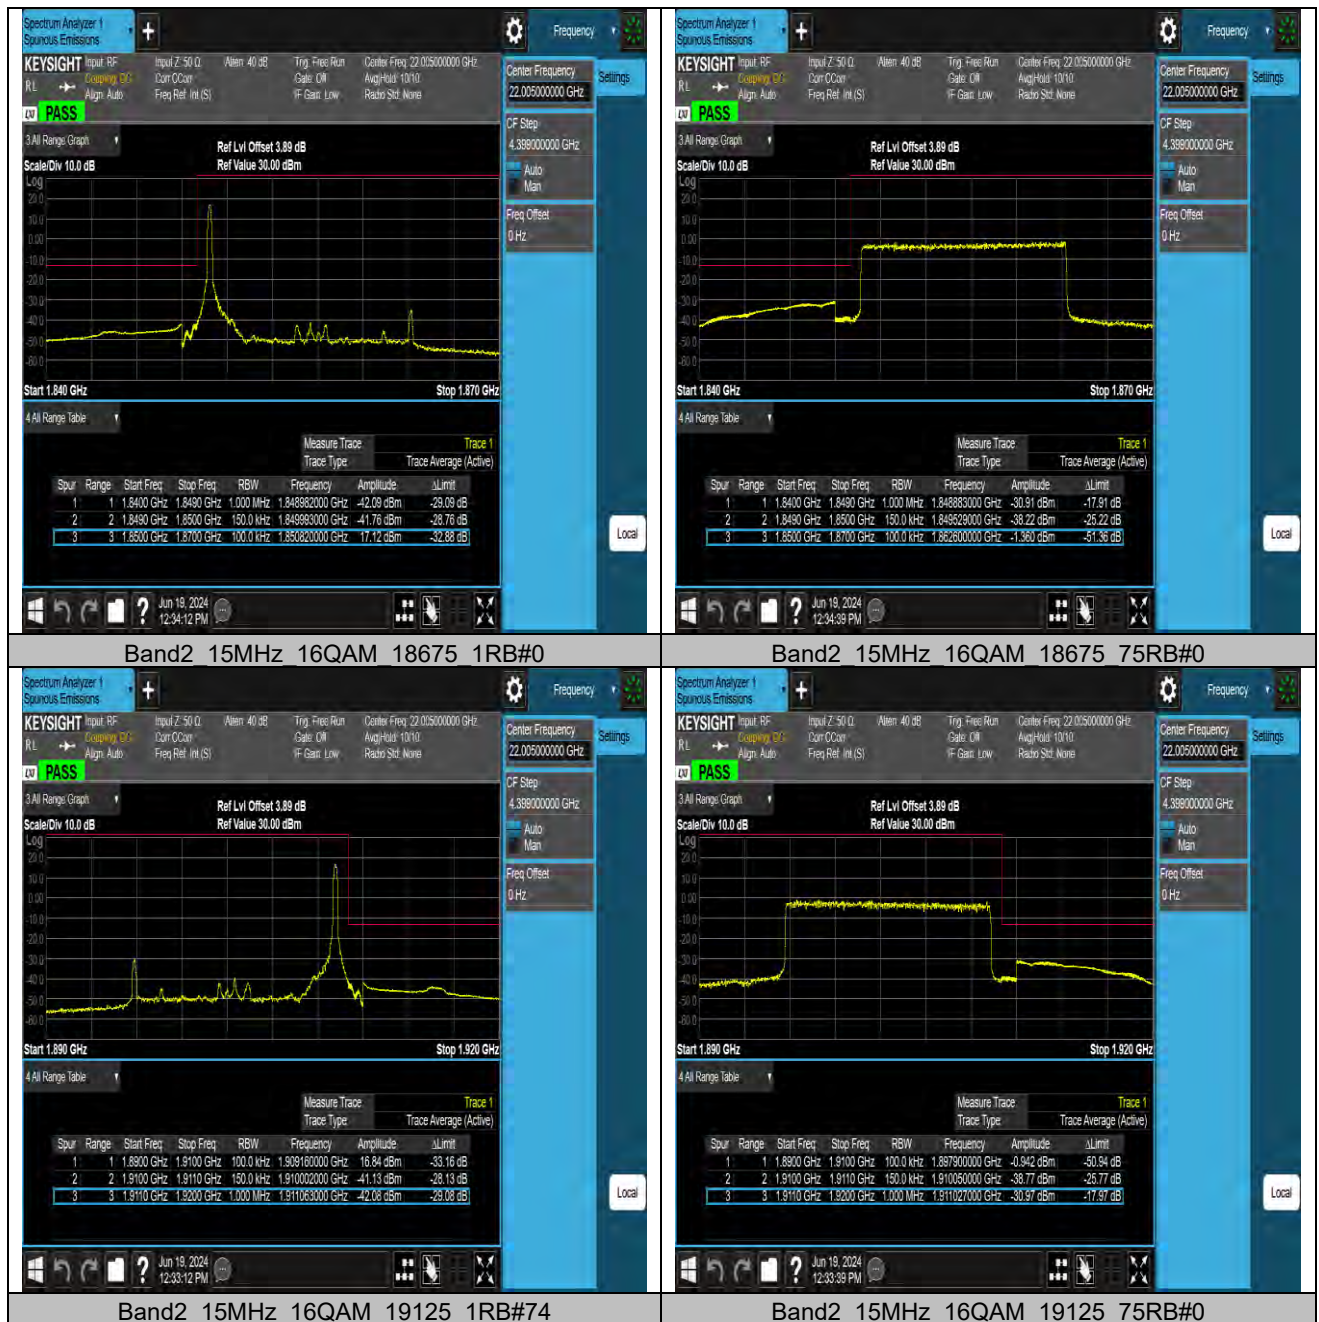



BUREAU
VERITAS


Test Report No.: W7L-P24100002RF06





BUREAU
VERITAS

Test Report No.: W7L-P24100002RF06

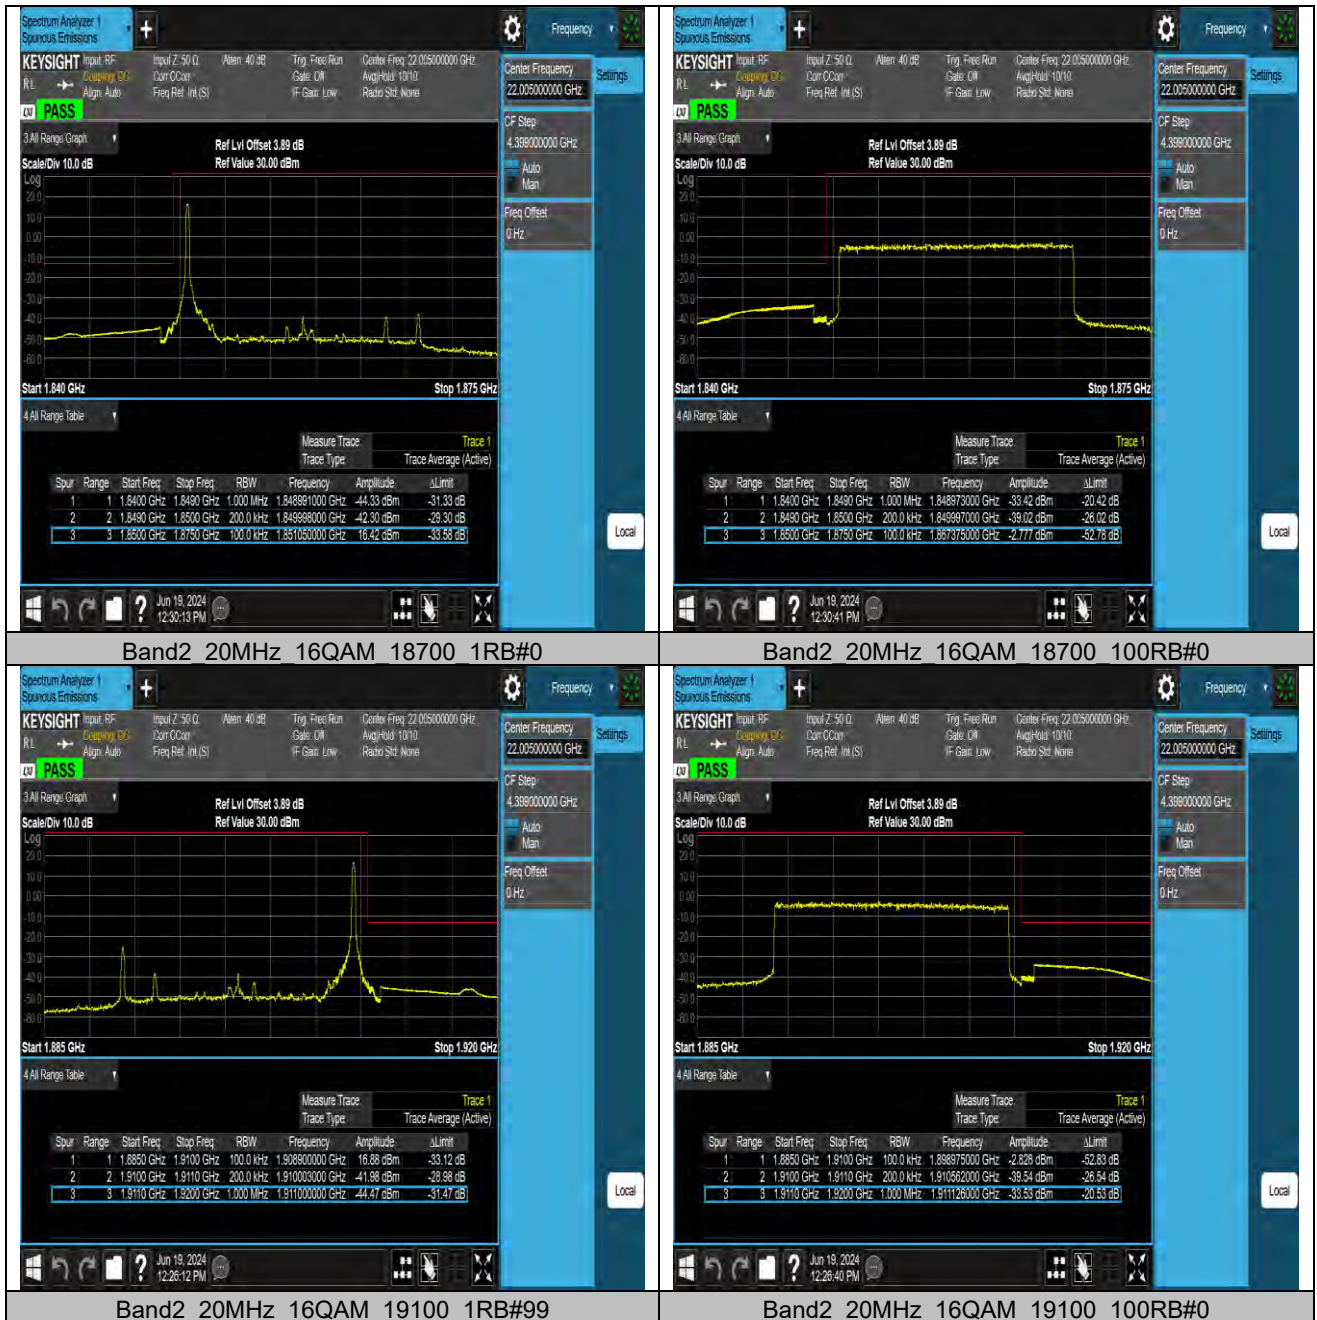

BV 7Layers Communications Technology
(Shenzhen) Co., Ltd

Room B37, Warehouse A5, No.3 Chiwan 4th Road,
Zhaoshang Street, Nanshan District Shenzhen,
Guangdong, People's Republic of China

Tel: +86 755 8869 6566
Fax: +86 755 8869 6577
Email: customerservice.sw@bureauveritas.com



Test Report No.: W7L-P24100002RF06

CONDUCTED SPURIOUS EMISSION

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Frequency Range	Result (dBm)	Verdict
Band2	1.4MHz	QPSK	18607	1RB#0	30~1000	-58.19	PASS
Band2	1.4MHz	QPSK	18607	1RB#0	1000~10000	-38.38	PASS
Band2	1.4MHz	QPSK	18607	1RB#0	10000~20000	-35.87	PASS
Band2	1.4MHz	QPSK	18607	1RB#5	30~1000	-58.18	PASS
Band2	1.4MHz	QPSK	18607	1RB#5	1000~10000	-38.29	PASS
Band2	1.4MHz	QPSK	18607	1RB#5	10000~20000	-35.97	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	30~1000	-58.18	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	1000~10000	-35.43	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	10000~20000	-35.77	PASS
Band2	1.4MHz	QPSK	18900	1RB#0	30~1000	-58.22	PASS
Band2	1.4MHz	QPSK	18900	1RB#0	1000~10000	-25.38	PASS
Band2	1.4MHz	QPSK	18900	1RB#0	10000~20000	-35.86	PASS
Band2	1.4MHz	QPSK	18900	1RB#5	30~1000	-58.22	PASS
Band2	1.4MHz	QPSK	18900	1RB#5	1000~10000	-30.40	PASS
Band2	1.4MHz	QPSK	18900	1RB#5	10000~20000	-35.80	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	30~1000	-58.20	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	1000~10000	-30.25	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	10000~20000	-35.86	PASS
Band2	1.4MHz	QPSK	19193	1RB#0	30~1000	-58.13	PASS
Band2	1.4MHz	QPSK	19193	1RB#0	1000~10000	-38.27	PASS
Band2	1.4MHz	QPSK	19193	1RB#0	10000~20000	-35.79	PASS
Band2	1.4MHz	QPSK	19193	1RB#5	30~1000	-58.22	PASS
Band2	1.4MHz	QPSK	19193	1RB#5	1000~10000	-38.38	PASS
Band2	1.4MHz	QPSK	19193	1RB#5	10000~20000	-35.84	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	30~1000	-58.15	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	1000~10000	-35.25	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	10000~20000	-35.83	PASS
Band2	3MHz	QPSK	18615	1RB#0	30~1000	-58.23	PASS
Band2	3MHz	QPSK	18615	1RB#0	1000~10000	-38.41	PASS
Band2	3MHz	QPSK	18615	1RB#0	10000~20000	-35.93	PASS
Band2	3MHz	QPSK	18615	1RB#14	30~1000	-58.17	PASS
Band2	3MHz	QPSK	18615	1RB#14	1000~10000	-38.30	PASS
Band2	3MHz	QPSK	18615	1RB#14	10000~20000	-35.89	PASS
Band2	3MHz	QPSK	18615	15RB#0	30~1000	-58.12	PASS
Band2	3MHz	QPSK	18615	15RB#0	1000~10000	-36.61	PASS
Band2	3MHz	QPSK	18615	15RB#0	10000~20000	-35.90	PASS
Band2	3MHz	QPSK	18900	1RB#0	30~1000	-58.21	PASS
Band2	3MHz	QPSK	18900	1RB#0	1000~10000	-38.43	PASS
Band2	3MHz	QPSK	18900	1RB#0	10000~20000	-35.91	PASS
Band2	3MHz	QPSK	18900	1RB#14	30~1000	-58.17	PASS
Band2	3MHz	QPSK	18900	1RB#14	1000~10000	-38.34	PASS
Band2	3MHz	QPSK	18900	1RB#14	10000~20000	-35.92	PASS
Band2	3MHz	QPSK	18900	15RB#0	30~1000	-58.17	PASS



BUREAU
VERITAS

Test Report No.: W7L-P24100002RF06

Band2	3MHz	QPSK	18900	15RB#0	1000~10000	-37.47	PASS
Band2	3MHz	QPSK	18900	15RB#0	10000~20000	-35.89	PASS
Band2	3MHz	QPSK	19185	1RB#0	30~1000	-58.18	PASS
Band2	3MHz	QPSK	19185	1RB#0	1000~10000	-38.34	PASS
Band2	3MHz	QPSK	19185	1RB#0	10000~20000	-35.93	PASS
Band2	3MHz	QPSK	19185	1RB#14	30~1000	-58.15	PASS
Band2	3MHz	QPSK	19185	1RB#14	1000~10000	-38.34	PASS
Band2	3MHz	QPSK	19185	1RB#14	10000~20000	-35.96	PASS
Band2	3MHz	QPSK	19185	15RB#0	30~1000	-58.22	PASS
Band2	3MHz	QPSK	19185	15RB#0	1000~10000	-36.51	PASS
Band2	3MHz	QPSK	19185	15RB#0	10000~20000	-35.87	PASS
Band2	5MHz	QPSK	18625	1RB#0	30~1000	-58.22	PASS
Band2	5MHz	QPSK	18625	1RB#0	1000~10000	-38.45	PASS
Band2	5MHz	QPSK	18625	1RB#0	10000~20000	-35.85	PASS
Band2	5MHz	QPSK	18625	1RB#24	30~1000	-58.25	PASS
Band2	5MHz	QPSK	18625	1RB#24	1000~10000	-38.39	PASS
Band2	5MHz	QPSK	18625	1RB#24	10000~20000	-35.95	PASS
Band2	5MHz	QPSK	18625	25RB#0	30~1000	-58.23	PASS
Band2	5MHz	QPSK	18625	25RB#0	1000~10000	-38.06	PASS
Band2	5MHz	QPSK	18625	25RB#0	10000~20000	-35.88	PASS
Band2	5MHz	QPSK	18900	1RB#0	30~1000	-58.23	PASS
Band2	5MHz	QPSK	18900	1RB#0	1000~10000	-38.43	PASS
Band2	5MHz	QPSK	18900	1RB#0	10000~20000	-35.77	PASS
Band2	5MHz	QPSK	18900	1RB#24	30~1000	-58.25	PASS
Band2	5MHz	QPSK	18900	1RB#24	1000~10000	-38.35	PASS
Band2	5MHz	QPSK	18900	1RB#24	10000~20000	-35.95	PASS
Band2	5MHz	QPSK	18900	25RB#0	30~1000	-58.19	PASS
Band2	5MHz	QPSK	18900	25RB#0	1000~10000	-38.38	PASS
Band2	5MHz	QPSK	18900	25RB#0	10000~20000	-35.80	PASS
Band2	5MHz	QPSK	19175	1RB#0	30~1000	-58.23	PASS
Band2	5MHz	QPSK	19175	1RB#0	1000~10000	-38.33	PASS
Band2	5MHz	QPSK	19175	1RB#0	10000~20000	-35.92	PASS
Band2	5MHz	QPSK	19175	1RB#24	30~1000	-58.22	PASS
Band2	5MHz	QPSK	19175	1RB#24	1000~10000	-38.33	PASS
Band2	5MHz	QPSK	19175	1RB#24	10000~20000	-35.93	PASS
Band2	5MHz	QPSK	19175	25RB#0	30~1000	-58.23	PASS
Band2	5MHz	QPSK	19175	25RB#0	1000~10000	-38.20	PASS
Band2	5MHz	QPSK	19175	25RB#0	10000~20000	-35.83	PASS
Band2	10MHz	QPSK	18650	1RB#0	30~1000	-58.25	PASS
Band2	10MHz	QPSK	18650	1RB#0	1000~10000	-38.28	PASS
Band2	10MHz	QPSK	18650	1RB#0	10000~20000	-35.82	PASS
Band2	10MHz	QPSK	18650	1RB#49	30~1000	-58.23	PASS
Band2	10MHz	QPSK	18650	1RB#49	1000~10000	-38.36	PASS
Band2	10MHz	QPSK	18650	1RB#49	10000~20000	-35.87	PASS
Band2	10MHz	QPSK	18650	50RB#0	30~1000	-58.21	PASS
Band2	10MHz	QPSK	18650	50RB#0	1000~10000	-38.41	PASS
Band2	10MHz	QPSK	18650	50RB#0	10000~20000	-35.92	PASS
Band2	10MHz	QPSK	18900	1RB#0	30~1000	-58.24	PASS
Band2	10MHz	QPSK	18900	1RB#0	1000~10000	-38.38	PASS
Band2	10MHz	QPSK	18900	1RB#0	10000~20000	-35.82	PASS
Band2	10MHz	QPSK	18900	1RB#49	30~1000	-58.22	PASS
Band2	10MHz	QPSK	18900	1RB#49	1000~10000	-38.42	PASS
Band2	10MHz	QPSK	18900	1RB#49	10000~20000	-35.79	PASS

BV 7Layers Communications Technology
(Shenzhen) Co., Ltd

Room B37, Warehouse A5, No.3 Chiwan 4th Road,
Zhaoshang Street, Nanshan District Shenzhen,
Guangdong, People's Republic of China

Tel: +86 755 8869 6566
Fax: +86 755 8869 6577
Email: customerservice.sw@bureauveritas.com



BUREAU
VERITAS

Test Report No.: W7L-P24100002RF06

Band2	10MHz	QPSK	18900	50RB#0	30~1000	-58.21	PASS
Band2	10MHz	QPSK	18900	50RB#0	1000~10000	-38.28	PASS
Band2	10MHz	QPSK	18900	50RB#0	10000~20000	-35.79	PASS
Band2	10MHz	QPSK	19150	1RB#0	30~1000	-58.19	PASS
Band2	10MHz	QPSK	19150	1RB#0	1000~10000	-38.41	PASS
Band2	10MHz	QPSK	19150	1RB#0	10000~20000	-35.83	PASS
Band2	10MHz	QPSK	19150	1RB#49	30~1000	-58.10	PASS
Band2	10MHz	QPSK	19150	1RB#49	1000~10000	-38.29	PASS
Band2	10MHz	QPSK	19150	1RB#49	10000~20000	-35.87	PASS
Band2	10MHz	QPSK	19150	50RB#0	30~1000	-58.21	PASS
Band2	10MHz	QPSK	19150	50RB#0	1000~10000	-38.27	PASS
Band2	10MHz	QPSK	19150	50RB#0	10000~20000	-35.91	PASS
Band2	15MHz	QPSK	18675	1RB#0	30~1000	-58.18	PASS
Band2	15MHz	QPSK	18675	1RB#0	1000~10000	-38.32	PASS
Band2	15MHz	QPSK	18675	1RB#0	10000~20000	-35.95	PASS
Band2	15MHz	QPSK	18675	1RB#74	30~1000	-58.14	PASS
Band2	15MHz	QPSK	18675	1RB#74	1000~10000	-38.36	PASS
Band2	15MHz	QPSK	18675	1RB#74	10000~20000	-35.86	PASS
Band2	15MHz	QPSK	18675	75RB#0	30~1000	-58.23	PASS
Band2	15MHz	QPSK	18675	75RB#0	1000~10000	-38.37	PASS
Band2	15MHz	QPSK	18675	75RB#0	10000~20000	-35.86	PASS
Band2	15MHz	QPSK	18900	1RB#0	30~1000	-58.22	PASS
Band2	15MHz	QPSK	18900	1RB#0	1000~10000	-38.39	PASS
Band2	15MHz	QPSK	18900	1RB#0	10000~20000	-35.84	PASS
Band2	15MHz	QPSK	18900	1RB#74	30~1000	-58.14	PASS
Band2	15MHz	QPSK	18900	1RB#74	1000~10000	-38.39	PASS
Band2	15MHz	QPSK	18900	1RB#74	10000~20000	-35.90	PASS
Band2	15MHz	QPSK	18900	75RB#0	30~1000	-58.12	PASS
Band2	15MHz	QPSK	18900	75RB#0	1000~10000	-38.44	PASS
Band2	15MHz	QPSK	18900	75RB#0	10000~20000	-35.99	PASS
Band2	15MHz	QPSK	19125	1RB#0	30~1000	-58.24	PASS
Band2	15MHz	QPSK	19125	1RB#0	1000~10000	-38.43	PASS
Band2	15MHz	QPSK	19125	1RB#0	10000~20000	-35.87	PASS
Band2	15MHz	QPSK	19125	1RB#74	30~1000	-58.19	PASS
Band2	15MHz	QPSK	19125	1RB#74	1000~10000	-38.37	PASS
Band2	15MHz	QPSK	19125	1RB#74	10000~20000	-35.86	PASS
Band2	15MHz	QPSK	19125	75RB#0	30~1000	-58.24	PASS
Band2	15MHz	QPSK	19125	75RB#0	1000~10000	-38.37	PASS
Band2	15MHz	QPSK	19125	75RB#0	10000~20000	-35.85	PASS
Band2	20MHz	QPSK	18700	1RB#0	30~1000	-58.11	PASS
Band2	20MHz	QPSK	18700	1RB#0	1000~10000	-38.26	PASS
Band2	20MHz	QPSK	18700	1RB#0	10000~20000	-35.74	PASS
Band2	20MHz	QPSK	18700	1RB#99	30~1000	-58.13	PASS
Band2	20MHz	QPSK	18700	1RB#99	1000~10000	-38.36	PASS
Band2	20MHz	QPSK	18700	1RB#99	10000~20000	-35.71	PASS
Band2	20MHz	QPSK	18700	100RB#0	30~1000	-58.16	PASS
Band2	20MHz	QPSK	18700	100RB#0	1000~10000	-38.42	PASS
Band2	20MHz	QPSK	18700	100RB#0	10000~20000	-35.91	PASS
Band2	20MHz	QPSK	18900	1RB#0	30~1000	-58.19	PASS
Band2	20MHz	QPSK	18900	1RB#0	1000~10000	-38.31	PASS
Band2	20MHz	QPSK	18900	1RB#0	10000~20000	-35.88	PASS
Band2	20MHz	QPSK	18900	1RB#99	30~1000	-58.11	PASS
Band2	20MHz	QPSK	18900	1RB#99	1000~10000	-38.33	PASS



**BUREAU
VERITAS**

Test Report No.: W7L-P24100002RF06

Band2	20MHz	QPSK	18900	1RB#99	10000~20000	-35.88	PASS
Band2	20MHz	QPSK	18900	100RB#0	30~1000	-58.14	PASS
Band2	20MHz	QPSK	18900	100RB#0	1000~10000	-38.31	PASS
Band2	20MHz	QPSK	18900	100RB#0	10000~20000	-35.81	PASS
Band2	20MHz	QPSK	19100	1RB#0	30~1000	-58.15	PASS
Band2	20MHz	QPSK	19100	1RB#0	1000~10000	-38.14	PASS
Band2	20MHz	QPSK	19100	1RB#0	10000~20000	-35.88	PASS
Band2	20MHz	QPSK	19100	1RB#99	30~1000	-58.22	PASS
Band2	20MHz	QPSK	19100	1RB#99	1000~10000	-38.38	PASS
Band2	20MHz	QPSK	19100	1RB#99	10000~20000	-35.77	PASS
Band2	20MHz	QPSK	19100	100RB#0	30~1000	-58.26	PASS
Band2	20MHz	QPSK	19100	100RB#0	1000~10000	-38.34	PASS
Band2	20MHz	QPSK	19100	100RB#0	10000~20000	-35.89	PASS

Test Graphs

