

Compliance Certification Services (Kunshan) Inc. Shenzhen Branch

Report No.: FYCR2606000176AT

1. Effective (Isotropic) Radiated Power Output Data

1.1 Test Result

1.1.1 Band2_EIRP

Band: 2								
ENV	Mode		Frequency (MHz)	Conducted Power (dBm)	Gain (dBi)	EIRP (dBm)		Verdict
	Network	Subset				Result	Limit	
NTNV	RMC	12.2kbps RMC	1852.4	23.80	1.12	24.92	<=33.01	Pass
			1880	23.67	1.12	24.79	<=33.01	Pass
			1907.6	23.74	1.12	24.86	<=33.01	Pass
	HSDPA	Subtest 1	1852.4	23.02	1.12	24.14	<=33.01	Pass
		Subtest 2	1852.4	23.00	1.12	24.12	<=33.01	Pass
		Subtest 3	1852.4	23.01	1.12	24.13	<=33.01	Pass
		Subtest 4	1852.4	23.00	1.12	24.12	<=33.01	Pass
		Subtest 1	1880	22.60	1.12	23.72	<=33.01	Pass
		Subtest 2	1880	22.55	1.12	23.67	<=33.01	Pass
		Subtest 3	1880	22.57	1.12	23.69	<=33.01	Pass
		Subtest 4	1880	22.52	1.12	23.64	<=33.01	Pass
		Subtest 1	1907.6	22.93	1.12	24.05	<=33.01	Pass
		Subtest 2	1907.6	22.92	1.12	24.04	<=33.01	Pass
		Subtest 3	1907.6	22.93	1.12	24.05	<=33.01	Pass
		Subtest 4	1907.6	22.93	1.12	24.05	<=33.01	Pass
	HSUPA	Subtest 1	1852.4	20.69	1.12	21.81	<=33.01	Pass
		Subtest 2	1852.4	20.93	1.12	22.05	<=33.01	Pass
		Subtest 3	1852.4	20.48	1.12	21.60	<=33.01	Pass
		Subtest 4	1852.4	20.91	1.12	22.03	<=33.01	Pass
		Subtest 5	1852.4	20.46	1.12	21.58	<=33.01	Pass
		Subtest 1	1880	20.67	1.12	21.79	<=33.01	Pass
		Subtest 2	1880	20.17	1.12	21.29	<=33.01	Pass
		Subtest 3	1880	20.51	1.12	21.63	<=33.01	Pass
		Subtest 4	1880	20.66	1.12	21.78	<=33.01	Pass
		Subtest 5	1880	20.15	1.12	21.27	<=33.01	Pass
		Subtest 1	1907.6	20.97	1.12	22.09	<=33.01	Pass
		Subtest 2	1907.6	20.48	1.12	21.60	<=33.01	Pass
		Subtest 3	1907.6	20.99	1.12	22.11	<=33.01	Pass
		Subtest 4	1907.6	20.74	1.12	21.86	<=33.01	Pass
		Subtest 5	1907.6	20.76	1.12	21.88	<=33.01	Pass

Note1: EIRP=Conducted Power+Antenna Gain

Compliance Certification Services (Kunshan) Inc. Shenzhen Branch

Report No.: FYCR2606000176AT

2. Frequency Stability

2.1 Test Result

2.1.1 Band2

Band: 2							
Network	Frequency (MHz)	Temp. (°C)	Voltage	Freq. Error (Hz)	Freq. vs. Rated (ppm)		Verdict
					Result	Limit	
RMC	1852.4	20	LV	-0.794	-0.0004	-2.5 to 2.5	Pass
			NV	3.541	0.0019	-2.5 to 2.5	Pass
			HV	3.204	0.0017	-2.5 to 2.5	Pass
		-30	NV	-0.157	-0.0001	-2.5 to 2.5	Pass
		-20	NV	-0.358	-0.0002	-2.5 to 2.5	Pass
		-10	NV	1.345	0.0007	-2.5 to 2.5	Pass
		0	NV	2.246	0.0012	-2.5 to 2.5	Pass
		10	NV	0.157	0.0001	-2.5 to 2.5	Pass
		30	NV	-2.017	-0.0011	-2.5 to 2.5	Pass
		40	NV	-0.136	-0.0001	-2.5 to 2.5	Pass
		50	NV	1.001	0.0005	-2.5 to 2.5	Pass
	1880	20	LV	-0.021	0.0000	-2.5 to 2.5	Pass
			NV	-1.853	-0.0010	-2.5 to 2.5	Pass
			HV	0.000	0.0000	-2.5 to 2.5	Pass
		-30	NV	0.243	0.0001	-2.5 to 2.5	Pass
		-20	NV	0.551	0.0003	-2.5 to 2.5	Pass
		-10	NV	1.101	0.0006	-2.5 to 2.5	Pass
		0	NV	-1.910	-0.0010	-2.5 to 2.5	Pass
		10	NV	-3.233	-0.0017	-2.5 to 2.5	Pass
		30	NV	-2.253	-0.0012	-2.5 to 2.5	Pass
		40	NV	-0.665	-0.0004	-2.5 to 2.5	Pass
		50	NV	0.751	0.0004	-2.5 to 2.5	Pass
	1907.6	20	LV	6.487	0.0034	-2.5 to 2.5	Pass
			NV	7.725	0.0040	-2.5 to 2.5	Pass
			HV	10.200	0.0053	-2.5 to 2.5	Pass
		-30	NV	9.506	0.0050	-2.5 to 2.5	Pass
		-20	NV	10.214	0.0054	-2.5 to 2.5	Pass
		-10	NV	11.573	0.0061	-2.5 to 2.5	Pass
		0	NV	8.826	0.0046	-2.5 to 2.5	Pass
		10	NV	9.155	0.0048	-2.5 to 2.5	Pass
		30	NV	8.626	0.0045	-2.5 to 2.5	Pass
		40	NV	6.738	0.0035	-2.5 to 2.5	Pass
		50	NV	8.612	0.0045	-2.5 to 2.5	Pass
HSDPA	1852.4	20	LV	7.854	0.0042	-2.5 to 2.5	Pass
			NV	13.769	0.0074	-2.5 to 2.5	Pass
			HV	12.002	0.0065	-2.5 to 2.5	Pass
		-30	NV	12.760	0.0069	-2.5 to 2.5	Pass
		-20	NV	10.464	0.0056	-2.5 to 2.5	Pass
		-10	NV	12.567	0.0068	-2.5 to 2.5	Pass
		0	NV	5.593	0.0030	-2.5 to 2.5	Pass
		10	NV	10.836	0.0058	-2.5 to 2.5	Pass

Compliance Certification Services (Kunshan) Inc. Shenzhen Branch

Report No.: FYCR2606000176AT

		30	NV	6.824	0.0037	-2.5 to 2.5	Pass
		40	NV	5.972	0.0032	-2.5 to 2.5	Pass
		50	NV	7.653	0.0041	-2.5 to 2.5	Pass
	1880	20	LV	7.002	0.0037	-2.5 to 2.5	Pass
			NV	7.031	0.0037	-2.5 to 2.5	Pass
			HV	6.673	0.0035	-2.5 to 2.5	Pass
		-30	NV	7.267	0.0039	-2.5 to 2.5	Pass
		-20	NV	7.546	0.0040	-2.5 to 2.5	Pass
		-10	NV	5.486	0.0029	-2.5 to 2.5	Pass
		0	NV	5.257	0.0028	-2.5 to 2.5	Pass
		10	NV	6.423	0.0034	-2.5 to 2.5	Pass
		30	NV	5.915	0.0031	-2.5 to 2.5	Pass
		40	NV	5.686	0.0030	-2.5 to 2.5	Pass
		50	NV	6.001	0.0032	-2.5 to 2.5	Pass
	1907.6	20	LV	3.955	0.0021	-2.5 to 2.5	Pass
			NV	4.613	0.0024	-2.5 to 2.5	Pass
			HV	4.270	0.0022	-2.5 to 2.5	Pass
		-30	NV	4.563	0.0024	-2.5 to 2.5	Pass
		-20	NV	3.519	0.0018	-2.5 to 2.5	Pass
		-10	NV	3.026	0.0016	-2.5 to 2.5	Pass
		0	NV	4.313	0.0023	-2.5 to 2.5	Pass
		10	NV	4.585	0.0024	-2.5 to 2.5	Pass
		30	NV	5.078	0.0027	-2.5 to 2.5	Pass
		40	NV	3.891	0.0020	-2.5 to 2.5	Pass
		50	NV	3.541	0.0019	-2.5 to 2.5	Pass
HSUPA	1852.4	20	LV	-0.064	0.0000	-2.5 to 2.5	Pass
			NV	-0.014	0.0000	-2.5 to 2.5	Pass
			HV	-0.515	-0.0003	-2.5 to 2.5	Pass
		-30	NV	0.286	0.0002	-2.5 to 2.5	Pass
		-20	NV	-0.594	-0.0003	-2.5 to 2.5	Pass
		-10	NV	-0.064	0.0000	-2.5 to 2.5	Pass
		0	NV	0.737	0.0004	-2.5 to 2.5	Pass
		10	NV	-0.193	-0.0001	-2.5 to 2.5	Pass
		30	NV	0.308	0.0002	-2.5 to 2.5	Pass
		40	NV	0.422	0.0002	-2.5 to 2.5	Pass
		50	NV	-0.486	-0.0003	-2.5 to 2.5	Pass
	1880	20	LV	18.604	0.0099	-2.5 to 2.5	Pass
			NV	0.122	0.0001	-2.5 to 2.5	Pass
			HV	0.987	0.0005	-2.5 to 2.5	Pass
		-30	NV	0.701	0.0004	-2.5 to 2.5	Pass
		-20	NV	-1.981	-0.0011	-2.5 to 2.5	Pass
		-10	NV	-0.229	-0.0001	-2.5 to 2.5	Pass
		0	NV	0.379	0.0002	-2.5 to 2.5	Pass
		10	NV	0.393	0.0002	-2.5 to 2.5	Pass
		30	NV	1.144	0.0006	-2.5 to 2.5	Pass
		40	NV	-1.194	-0.0006	-2.5 to 2.5	Pass
		50	NV	-2.525	-0.0013	-2.5 to 2.5	Pass
	1907.6	20	LV	-1.237	-0.0006	-2.5 to 2.5	Pass
			NV	-0.765	-0.0004	-2.5 to 2.5	Pass
			HV	1.116	0.0006	-2.5 to 2.5	Pass
		-30	NV	1.609	0.0008	-2.5 to 2.5	Pass
		-20	NV	0.608	0.0003	-2.5 to 2.5	Pass
		-10	NV	0.436	0.0002	-2.5 to 2.5	Pass
		0	NV	-0.544	-0.0003	-2.5 to 2.5	Pass

Compliance Certification Services (Kunshan) Inc. Shenzhen Branch

Report No.: FYCR2606000176AT

		10	NV	-0.429	-0.0002	-2.5 to 2.5	Pass
		30	NV	-0.615	-0.0003	-2.5 to 2.5	Pass
		40	NV	-0.336	-0.0002	-2.5 to 2.5	Pass
		50	NV	-0.029	0.0000	-2.5 to 2.5	Pass

3. 99% & 26dB Bandwidth

3.1 Test Result

3.1.1 Band2_OBW


Band: 2						
ENV	Mode		Frequency (MHz)	99% Occupied Bandwidth (MHz)		Verdict
	Network	Subset		Result	Limit	
NTNV	RMC	12.2kbps RMC	1852.4	4.151	/	Pass
			1880	4.157	/	Pass
			1907.6	4.160	/	Pass
	HSDPA	Subtest 1	1852.4	4.150	/	Pass
			1880	4.157	/	Pass
			1907.6	4.144	/	Pass
	HSUPA	Subtest 1	1852.4	4.140	/	Pass
			1880	4.166	/	Pass
			1907.6	4.152	/	Pass

3.1.2 Band2_XDB

Band: 2						
ENV	Mode		Frequency (MHz)	26dB Bandwidth (MHz)		Verdict
	Network	Subset		Result	Limit	
NTNV	RMC	12.2kbps RMC	1852.4	4.636	/	Pass
			1880	4.642	/	Pass
			1907.6	4.656	/	Pass
	HSDPA	Subtest 1	1852.4	4.609	/	Pass
			1880	4.616	/	Pass
			1907.6	4.644	/	Pass
	HSUPA	Subtest 1	1852.4	4.650	/	Pass
			1880	4.646	/	Pass
			1907.6	4.640	/	Pass

3.2 Test Graph


3.2.1 Band2_OBW

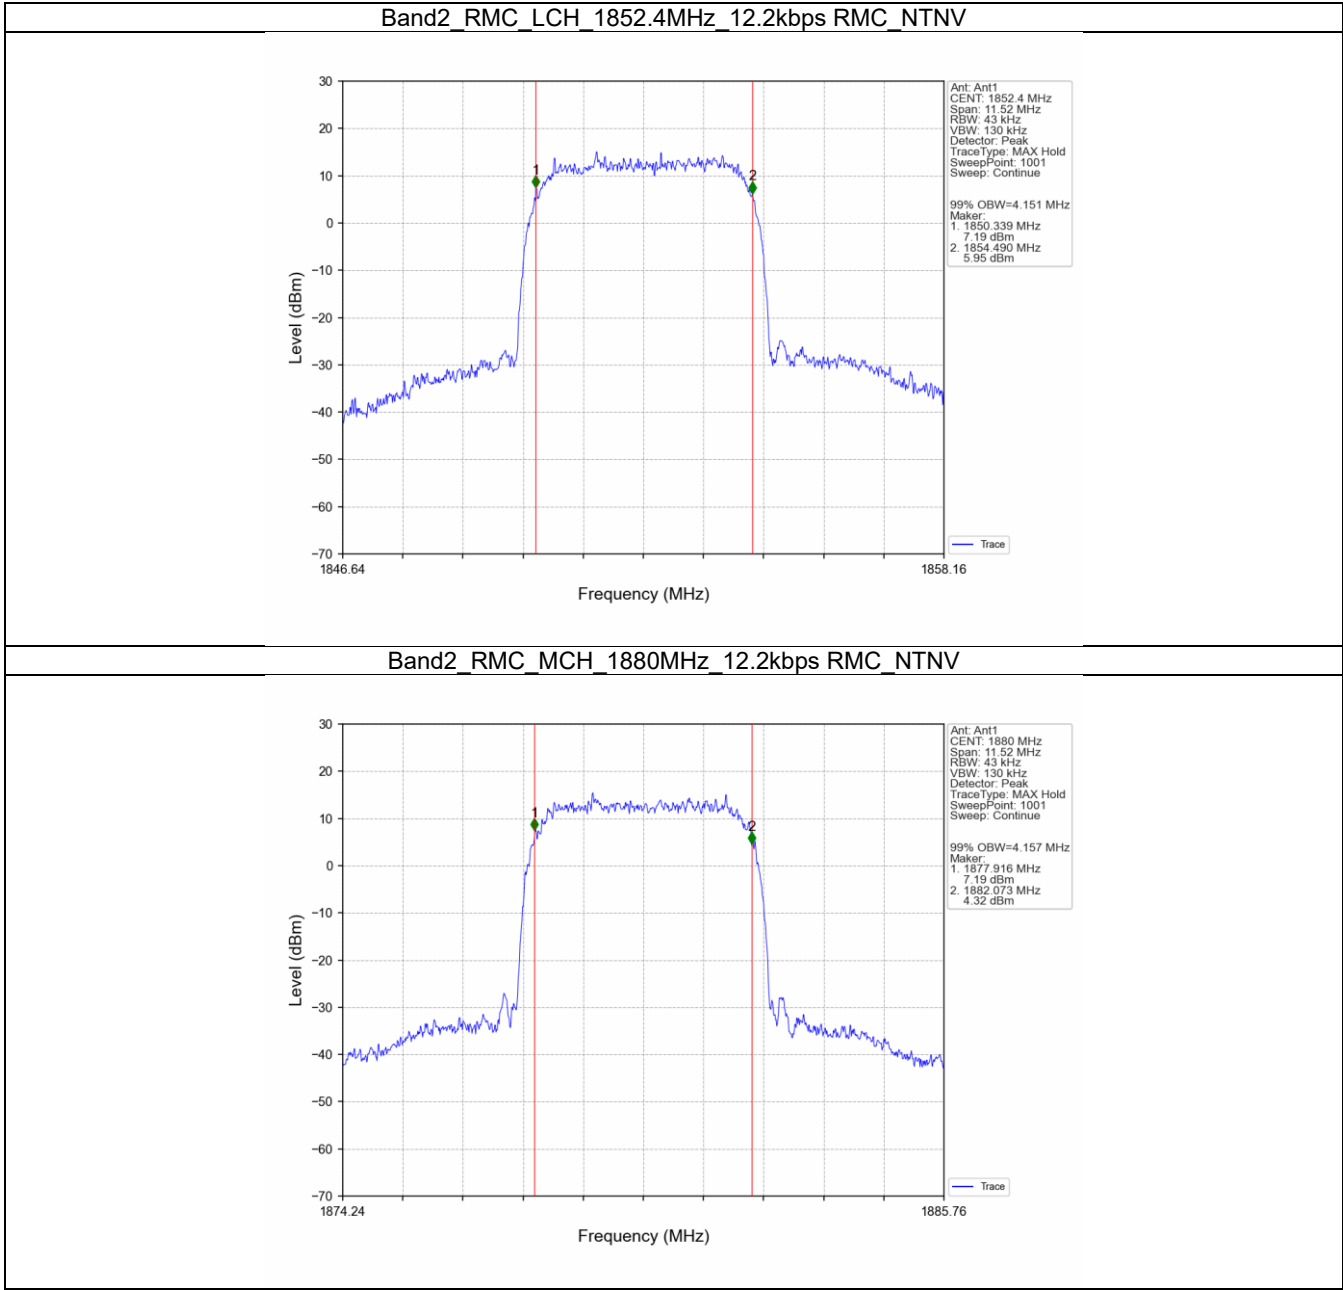


Compliance Certification Services (Kunshan) Inc. Shenzhen Branch

Report No.: FYCR2606000176AT

Band2_RMC_HCH_1907.6MHz_12.2kbps RMC_NTNV

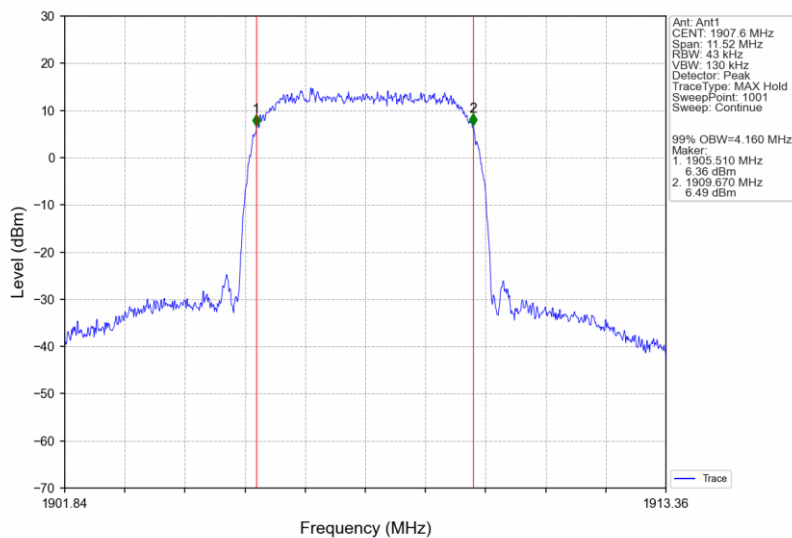


Band2_HSDPA_LCH_1852.4MHz_Subtest 1_NTNV

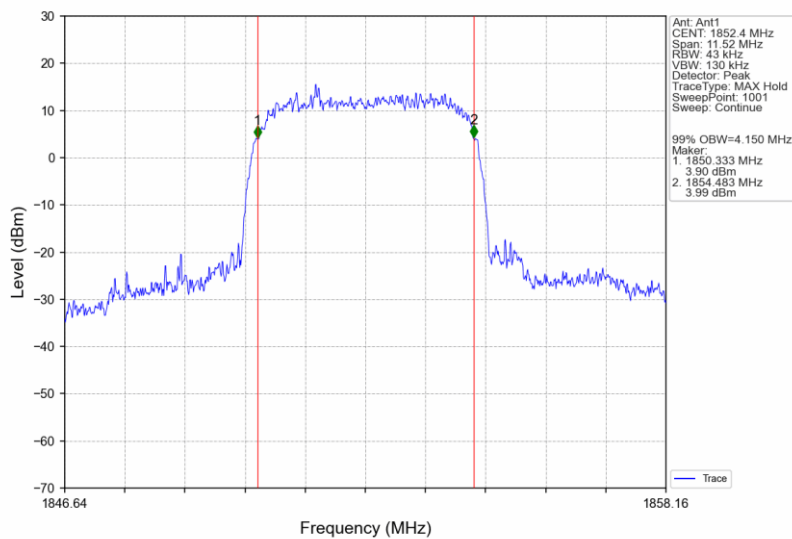


Compliance Certification Services (Kunshan) Inc. Shenzhen Branch

Report No.: FYCR2606000176AT

Band2_HSDPA_MCH_1880MHz_Subtest 1_NTNV

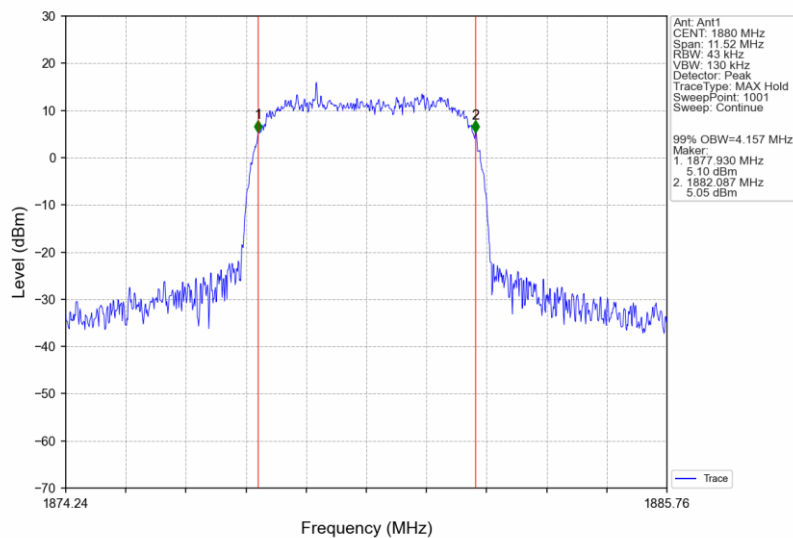


Band2_HSDPA_HCH_1907.6MHz_Subtest 1_NTNV

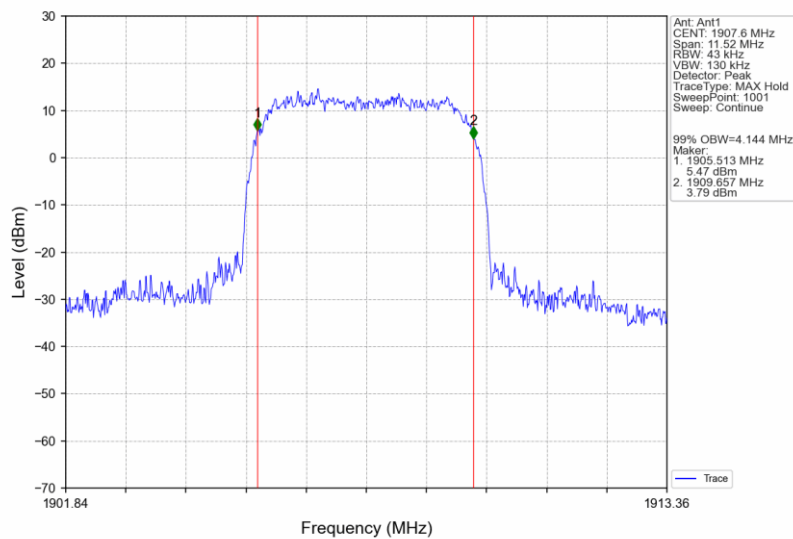


Compliance Certification Services (Kunshan) Inc. Shenzhen Branch

Report No.: FYCR2606000176AT

Band2_HSUPA_LCH_1852.4MHz_Subtest 1_NTNV

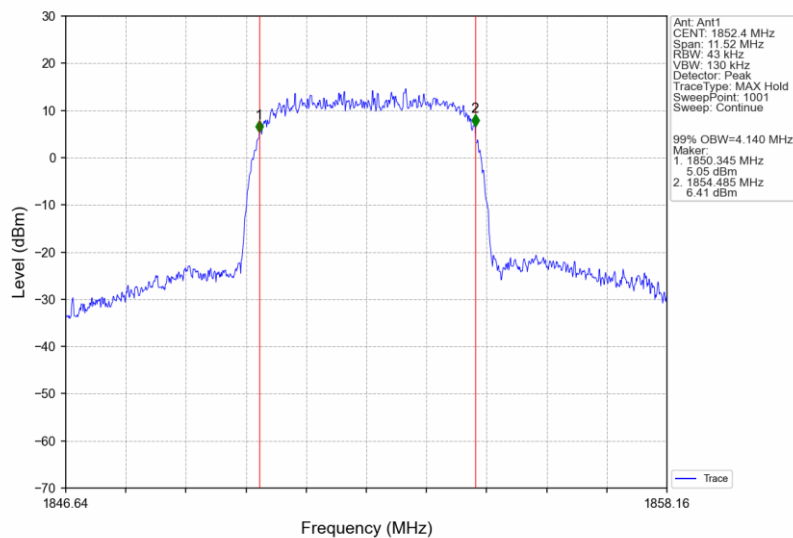


Band2_HSUPA_MCH_1880MHz_Subtest 1_NTNV

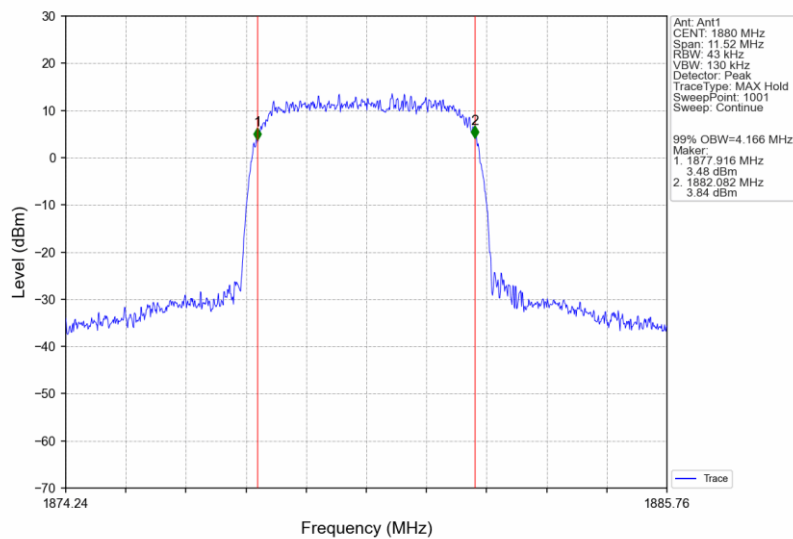


Compliance Certification Services (Kunshan) Inc. Shenzhen Branch

Report No.: FYCR2606000176AT

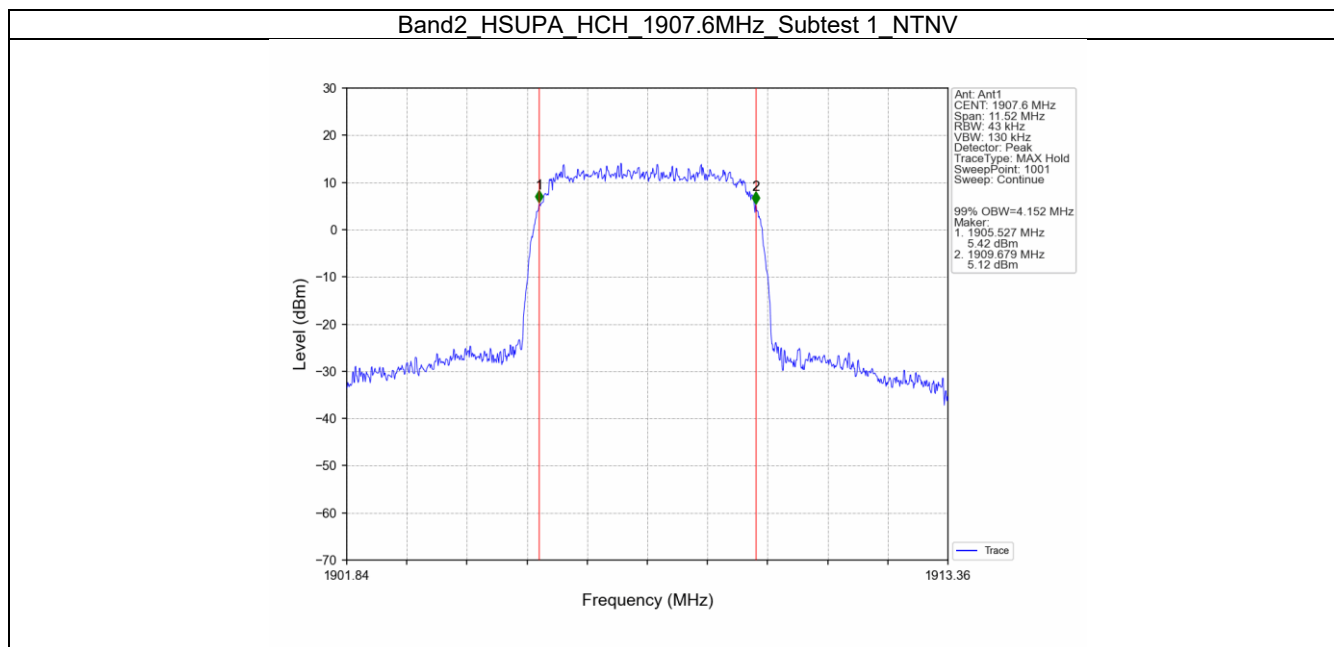


3.2.2 Band2_XDB

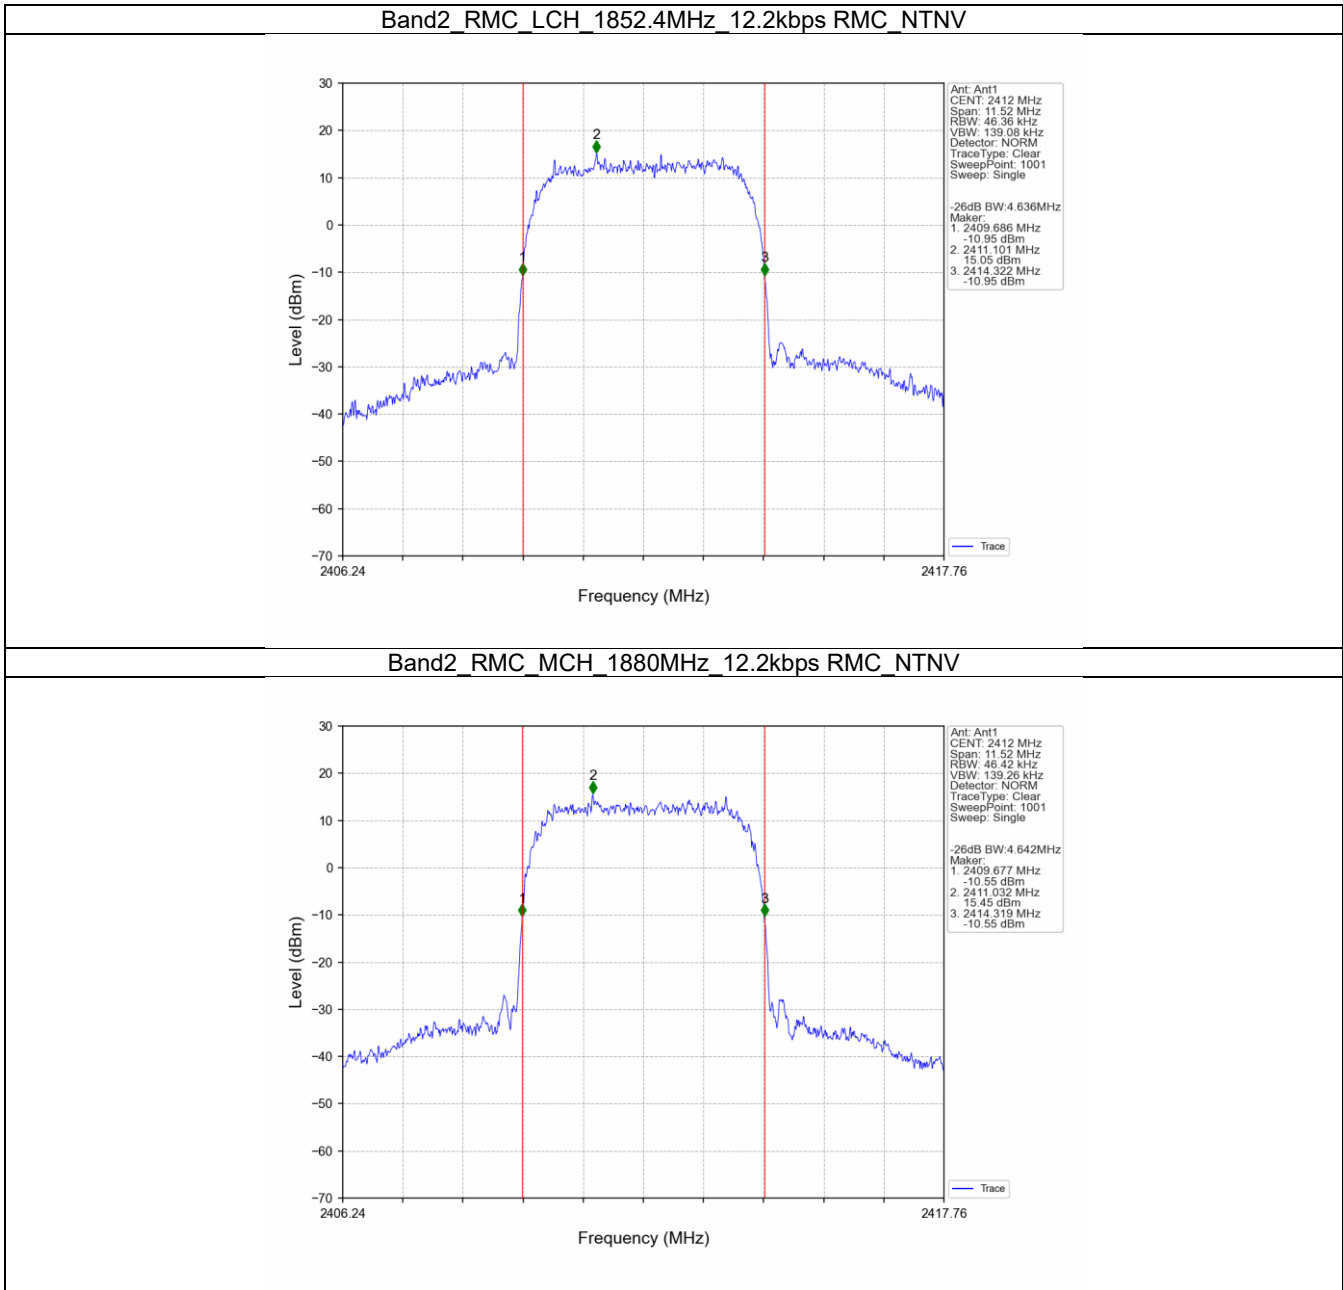


Compliance Certification Services (Kunshan) Inc. Shenzhen Branch

Report No.: FYCR2606000176AT

Band2_RMC_HCH_1907.6MHz_12.2kbps RMC_NTNV

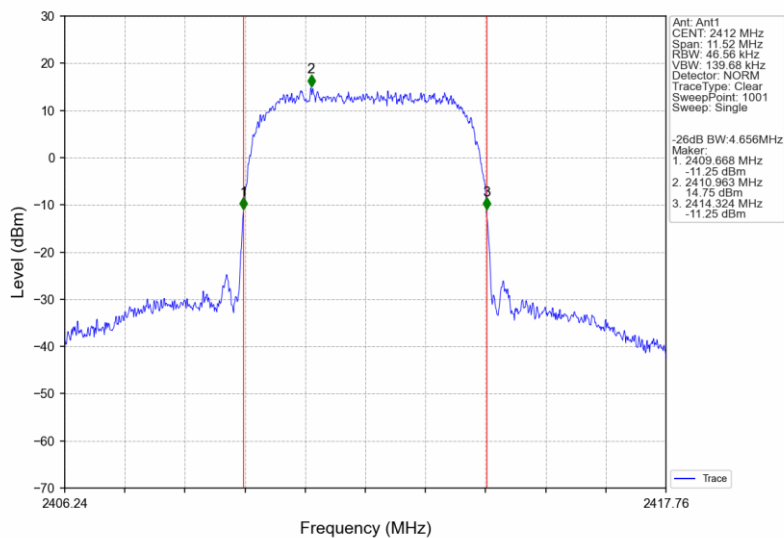


Band2_HSDPA_LCH_1852.4MHz_Subtest 1_NTNV

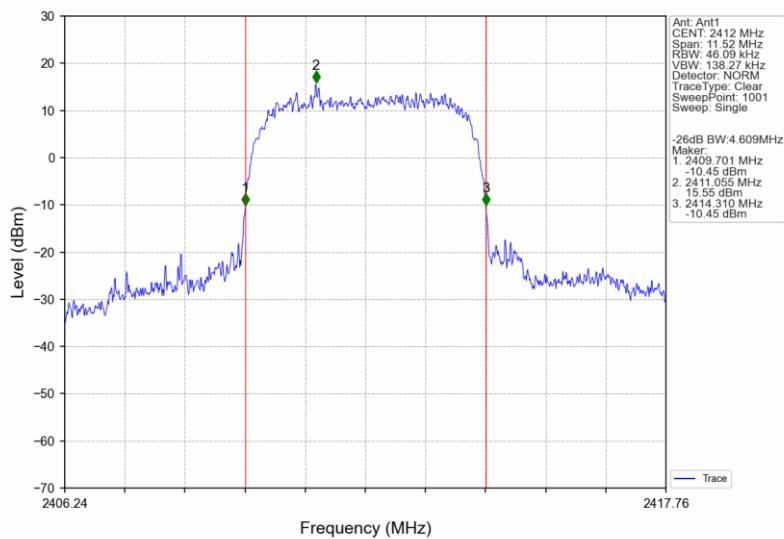


Compliance Certification Services (Kunshan) Inc. Shenzhen Branch

Report No.: FYCR2606000176AT

Band2_HSDPA_MCH_1880MHz_Subtest 1_NTNV

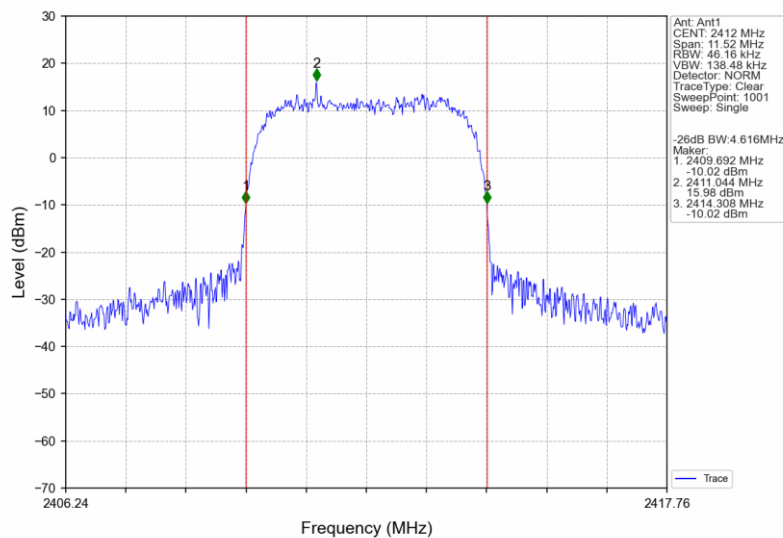


Band2_HSDPA_HCH_1907.6MHz_Subtest 1_NTNV

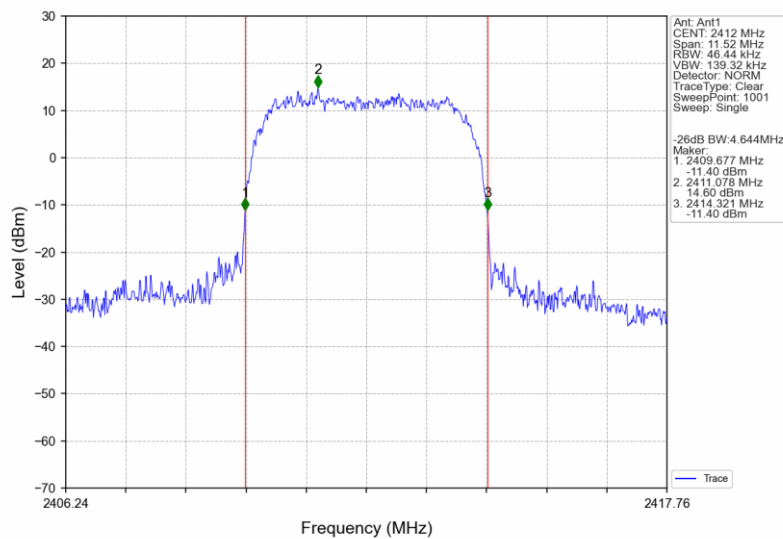


Compliance Certification Services (Kunshan) Inc. Shenzhen Branch

Report No.: FYCR2606000176AT

Band2_HSUPA_LCH_1852.4MHz_Subtest 1_NTNV

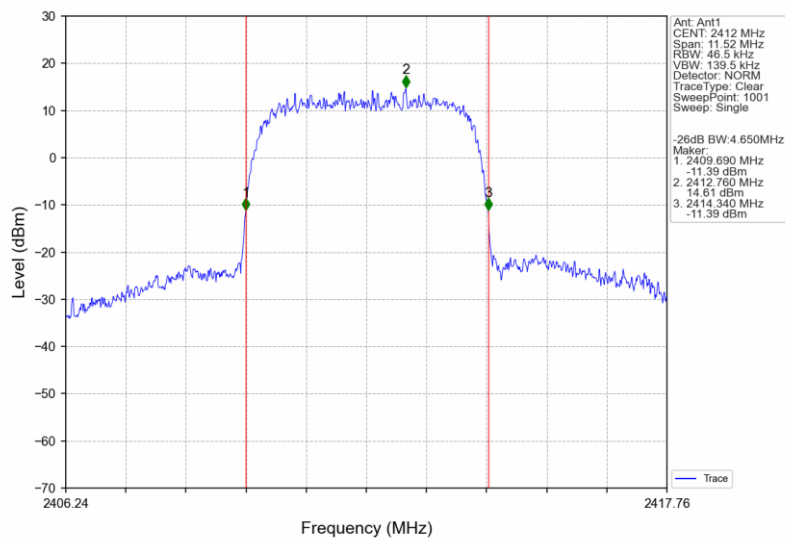


Band2_HSUPA_MCH_1880MHz_Subtest 1_NTNV

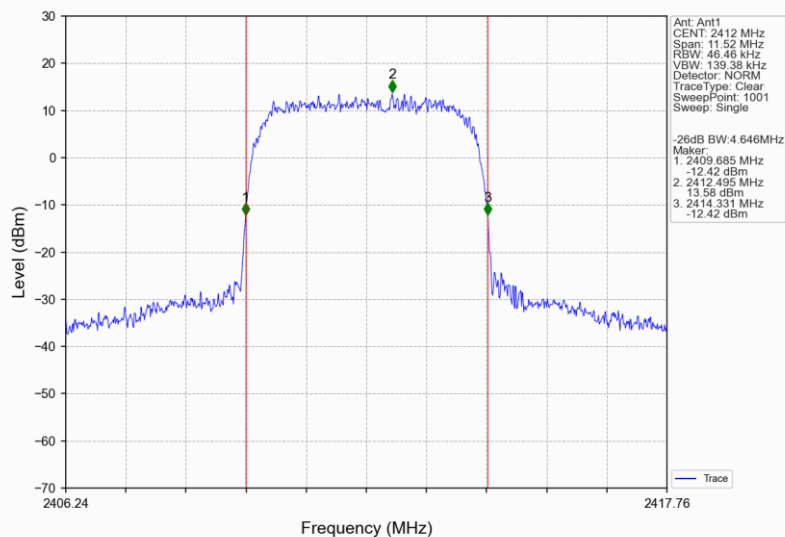

Compliance Certification Services (Kunshan) Inc. Shenzhen Branch

Report No.: FYCR2606000176AT

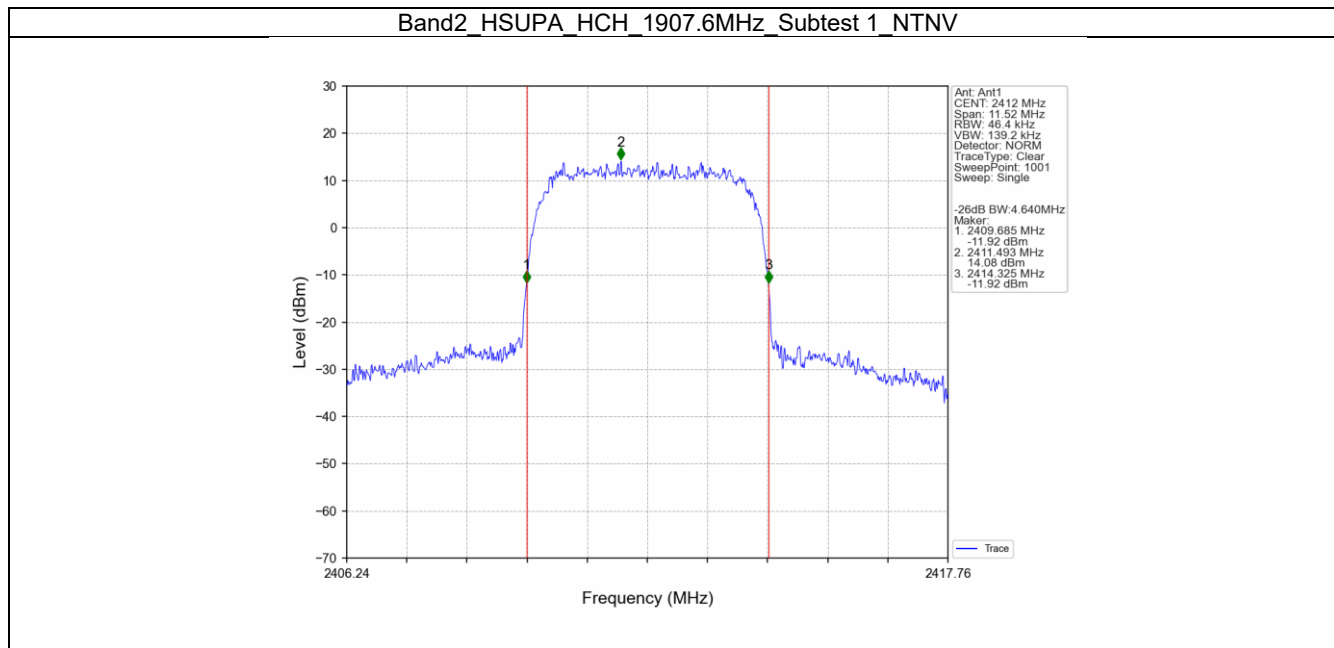

Compliance Certification Services (Kunshan) Inc. Shenzhen Branch

Report No.: FYCR2606000176AT

4. Peak-Average Ratio

4.1 Test Result

4.1.1 Band2


Band: 2						
ENV	Mode		Frequency (MHz)	Peak-Average Ratio (dB)		Verdict
	Network	Subset		Result	Limit	
NTNV	RMC	12.2kbps RMC	1852.4	2.78	<=13	Pass
			1880	2.90	<=13	Pass
			1907.6	2.86	<=13	Pass
	HSDPA	Subtest 1	1852.4	5.73	<=13	Pass
			1880	5.69	<=13	Pass
			1907.6	5.79	<=13	Pass
	HSUPA	Subtest 1	1852.4	6.33	<=13	Pass
			1880	6.50	<=13	Pass
			1907.6	6.42	<=13	Pass

Compliance Certification Services (Kunshan) Inc. Shenzhen Branch

Report No.: FYCR2606000176AT

4.2 Test Graph


4.2.1 Band2

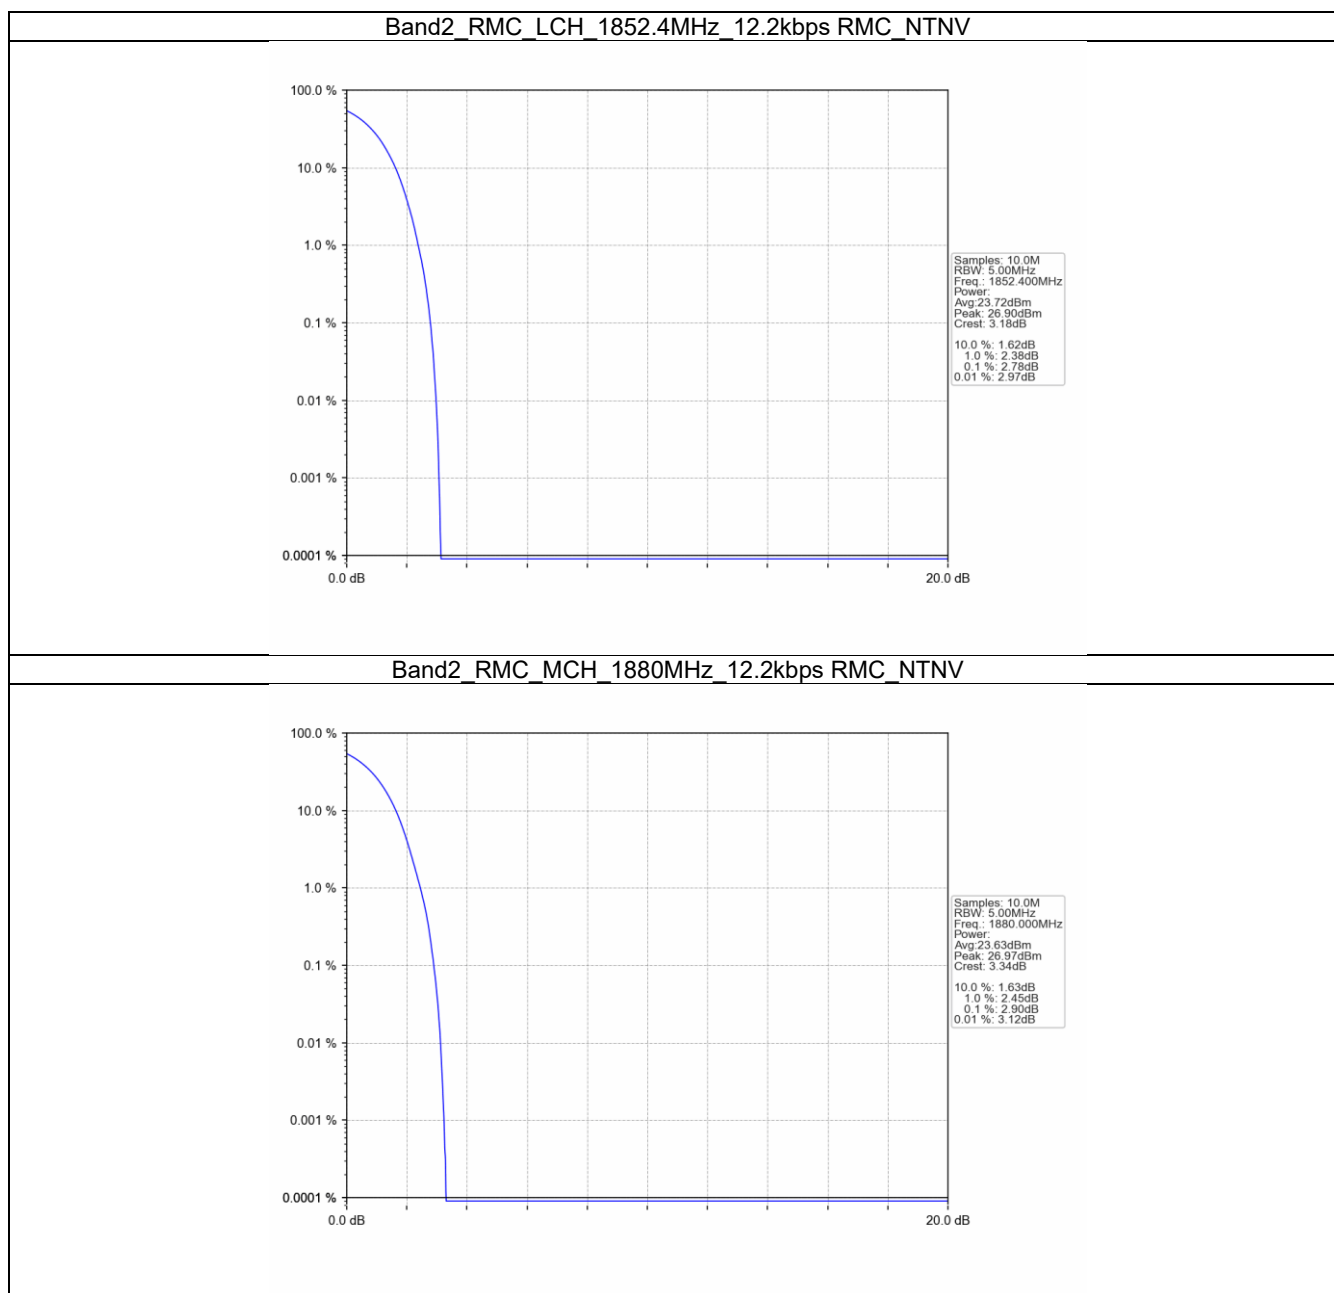


Compliance Certification Services (Kunshan) Inc. Shenzhen Branch

Report No.: FYCR2606000176AT

Band2_RMC_HCH_1907.6MHz_12.2kbps RMC_NTNV

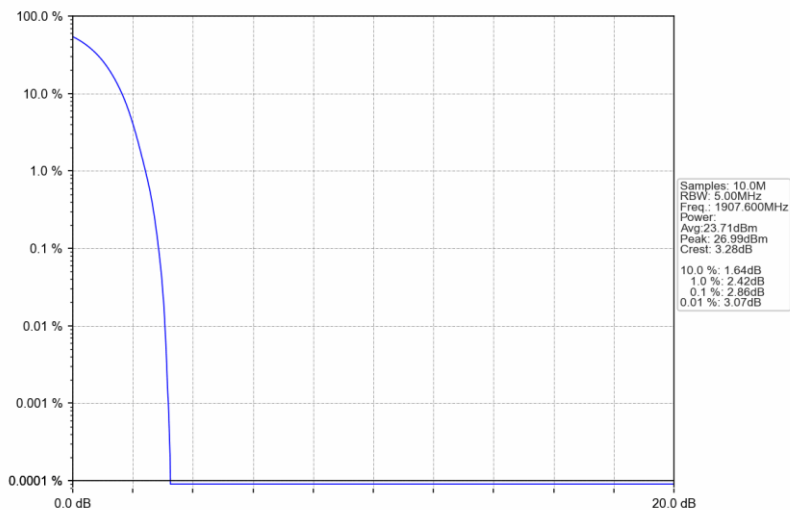


Band2_HSDPA_LCH_1852.4MHz_Subtest 1_NTNV

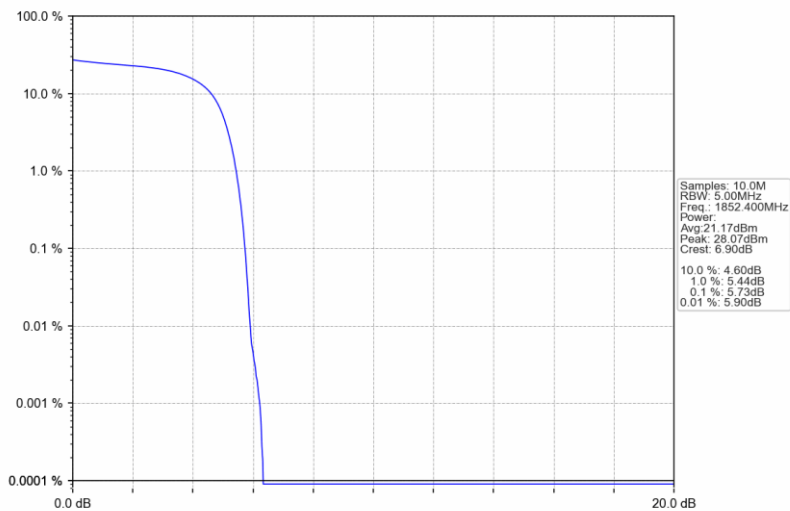


Compliance Certification Services (Kunshan) Inc. Shenzhen Branch

Report No.: FYCR2606000176AT

Band2_HSDPA_MCH_1880MHz_Subtest 1_NTNV

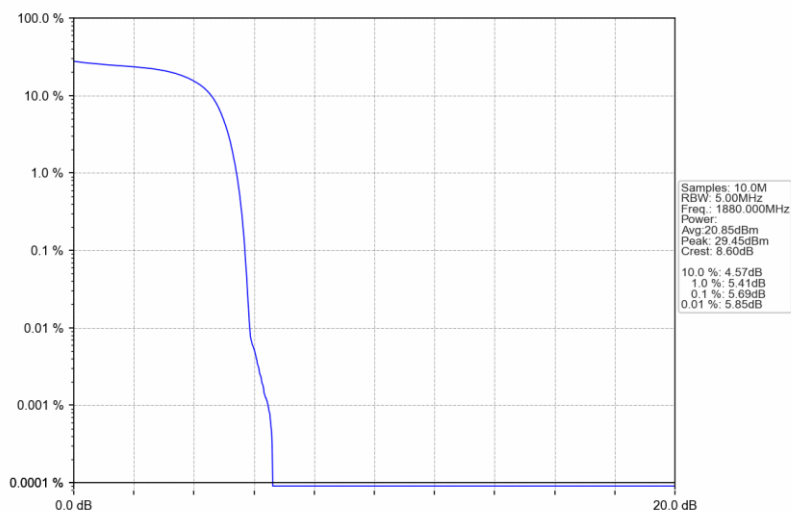


Band2_HSDPA_HCH_1907.6MHz_Subtest 1_NTNV

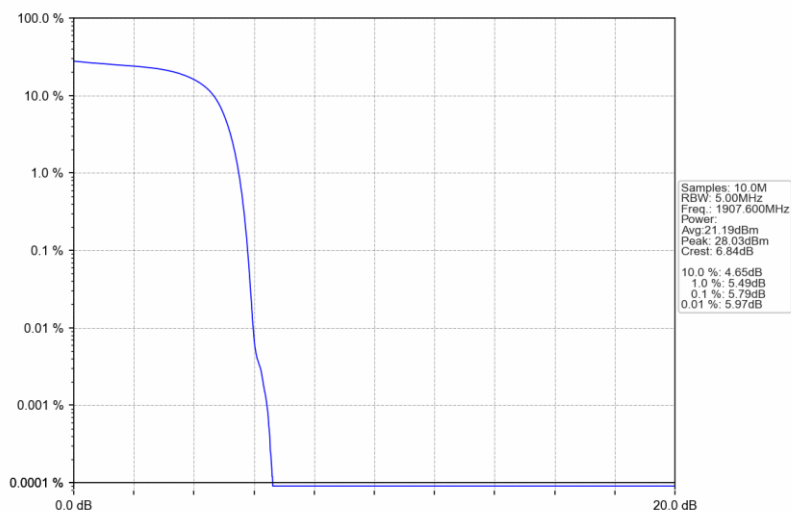


Compliance Certification Services (Kunshan) Inc. Shenzhen Branch

Report No.: FYCR2606000176AT

Band2_HSUPA_LCH_1852.4MHz_Subtest 1_NTNV

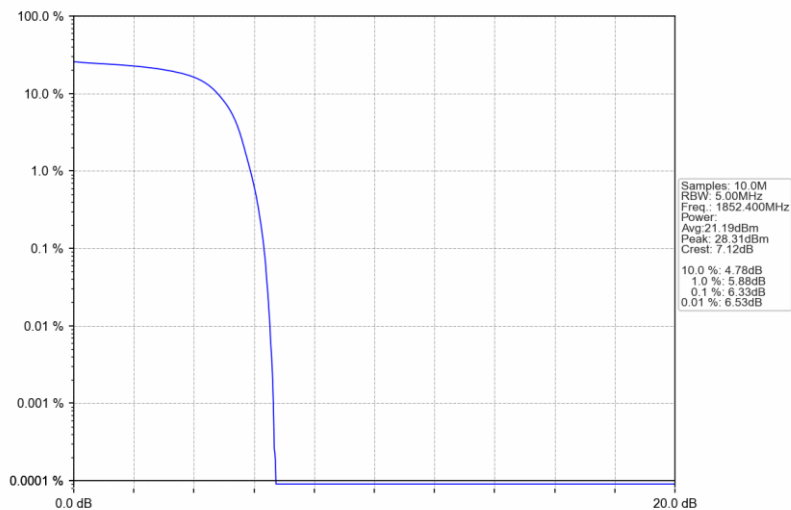


Band2_HSUPA_MCH_1880MHz_Subtest 1_NTNV

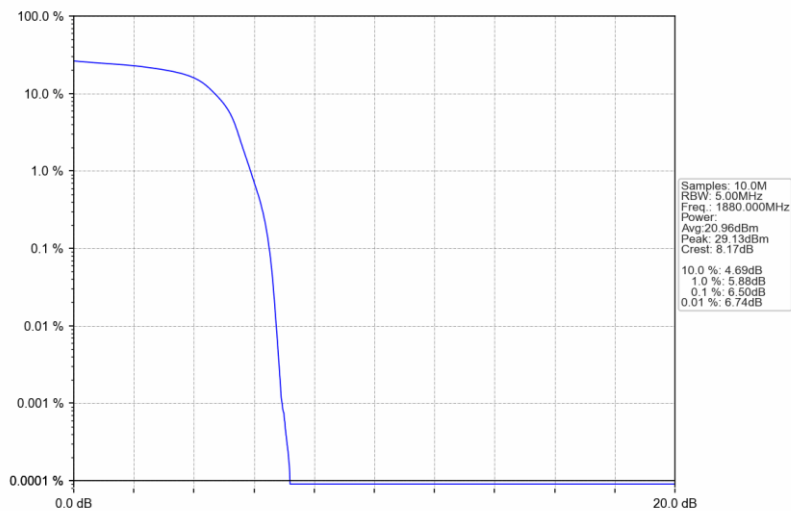

Compliance Certification Services (Kunshan) Inc. Shenzhen Branch

Report No.: FYCR2606000176AT

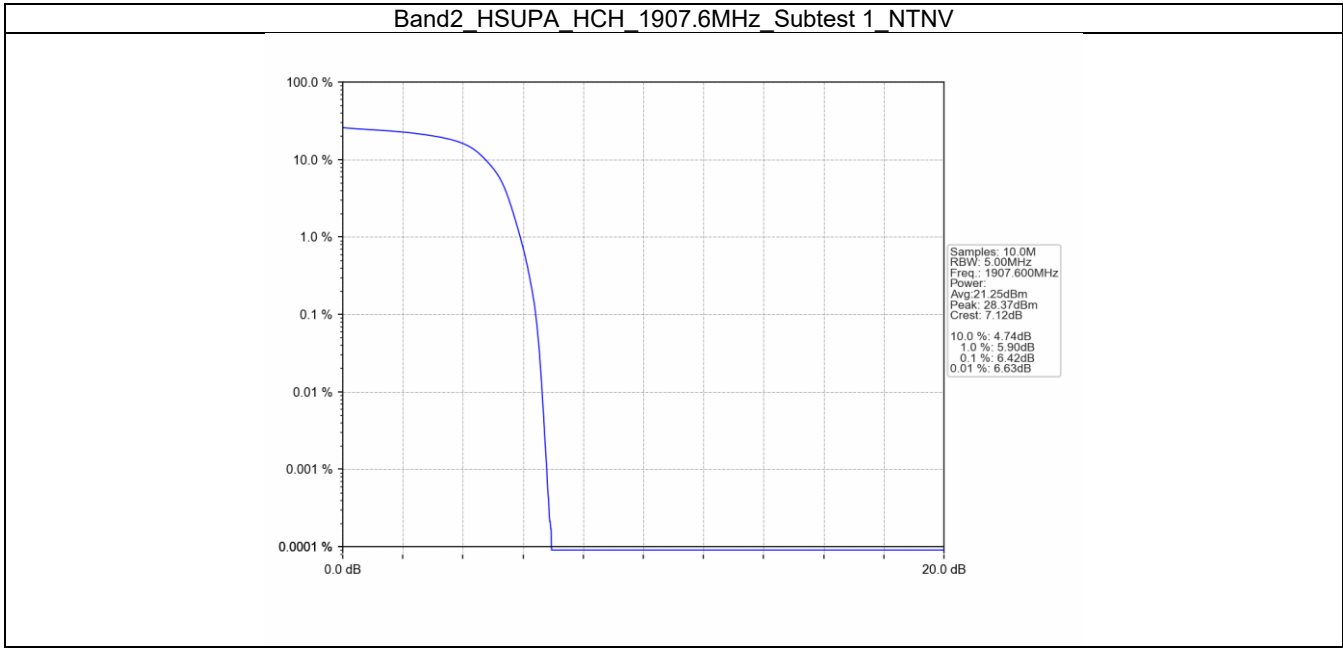

Compliance Certification Services (Kunshan) Inc. Shenzhen Branch

Report No.: FYCR2606000176AT

5. Spurious Emission


5.1 Test Result

5.1.1 Band2

Band: 2						
ENV	Mode		Frequency (MHz)	Spurious Emission		Verdict
	Network	Subset		Result	Limit	
NTNV	RMC	12.2kbps RMC	1852.4	Refer To Test Graph	Pass	
			1880	Refer To Test Graph	Pass	
			1907.6	Refer To Test Graph	Pass	
	HSDPA	Subtest 1	1852.4	Refer To Test Graph	Pass	
			1880	Refer To Test Graph	Pass	
			1907.6	Refer To Test Graph	Pass	
	HSUPA	Subtest 1	1852.4	Refer To Test Graph	Pass	
			1880	Refer To Test Graph	Pass	
			1907.6	Refer To Test Graph	Pass	

5.2 Test Graph


5.2.1 Band2

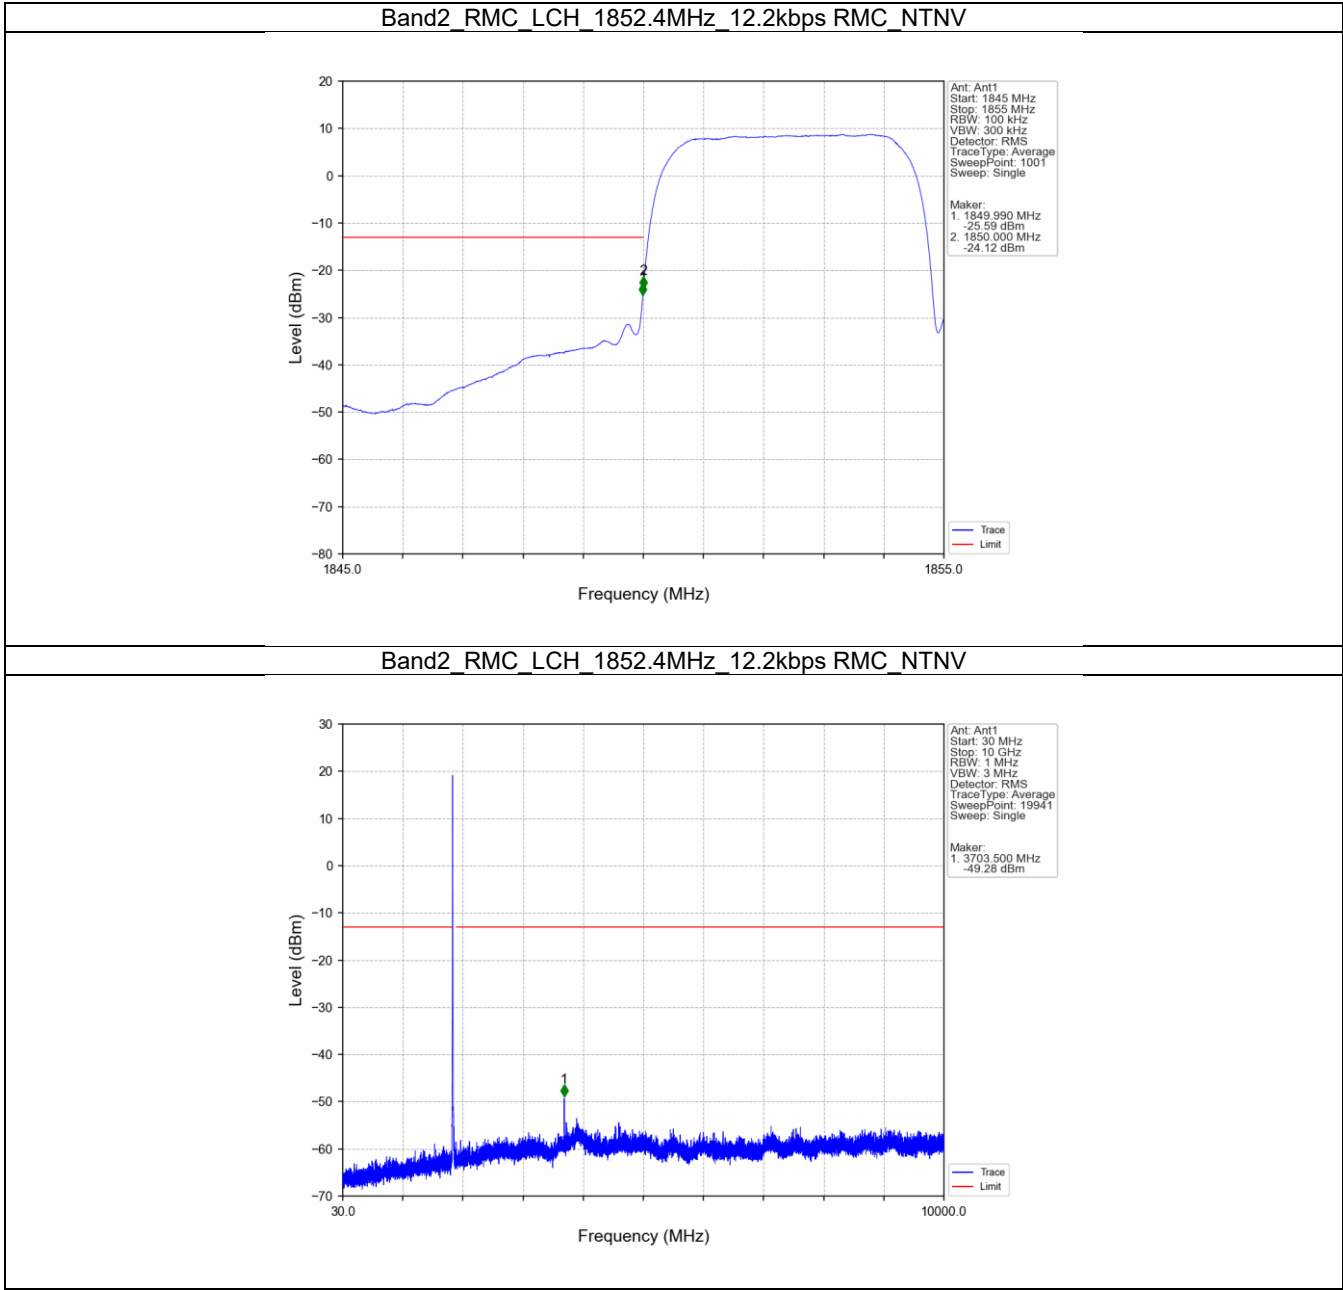


Compliance Certification Services (Kunshan) Inc. Shenzhen Branch

Report No.: FYCR2606000176AT

Band2_RMC_LCH_1852.4MHz_12.2kbps RMC_NTNV

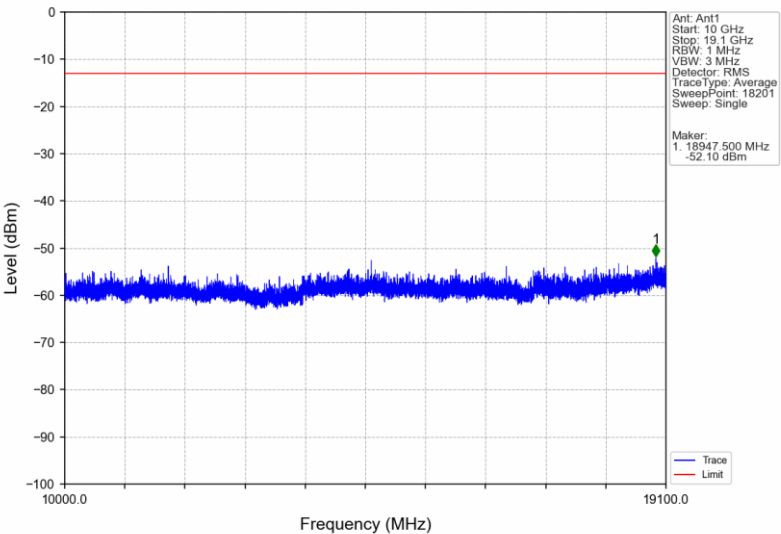


Band2_RMC_MCH_1880MHz_12.2kbps RMC_NTNV

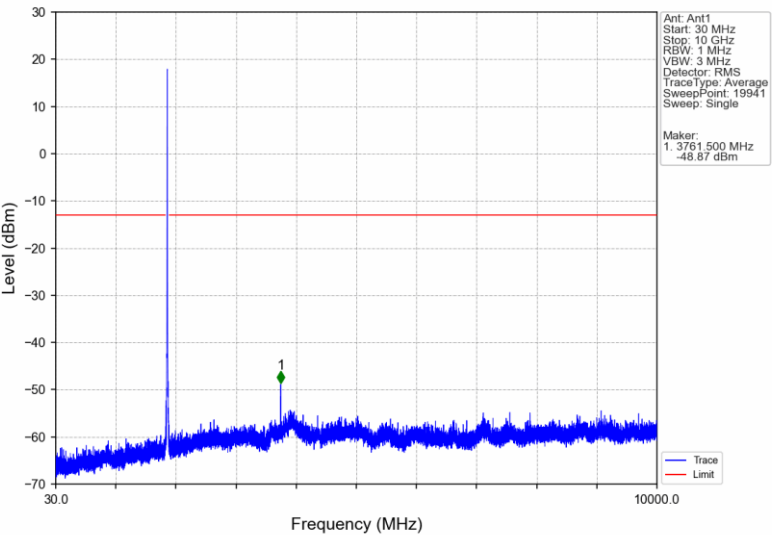


Compliance Certification Services (Kunshan) Inc. Shenzhen Branch

Report No.: FYCR2606000176AT

Band2_RMC_MCH_1880MHz_12.2kbps RMC_NTNV

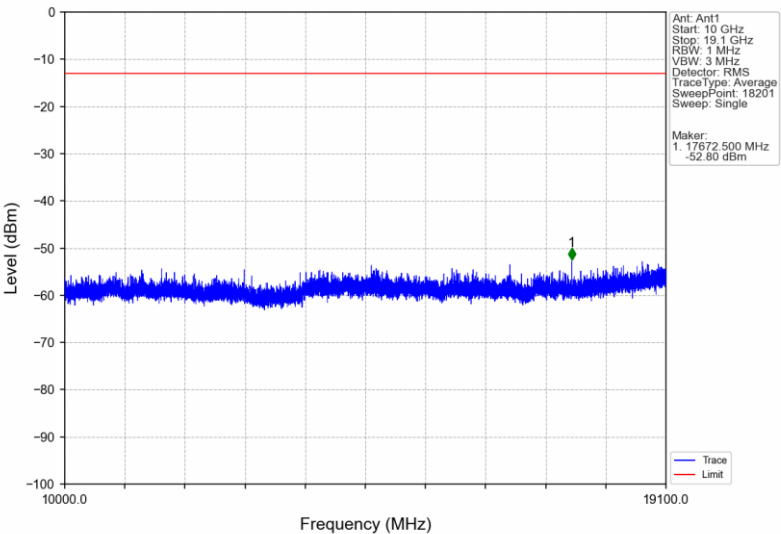


Band2_RMC_HCH_1907.6MHz_12.2kbps RMC_NTNV

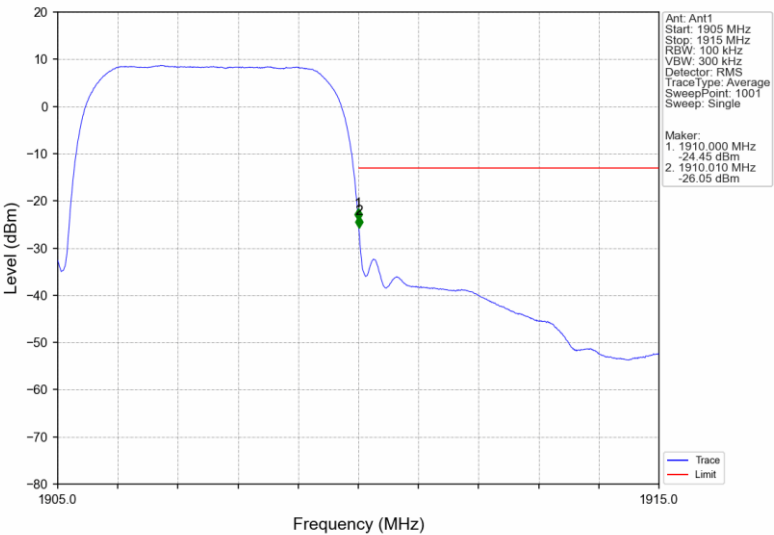


Compliance Certification Services (Kunshan) Inc. Shenzhen Branch

Report No.: FYCR2606000176AT

Band2_RMC_HCH_1907.6MHz_12.2kbps RMC_NTNV

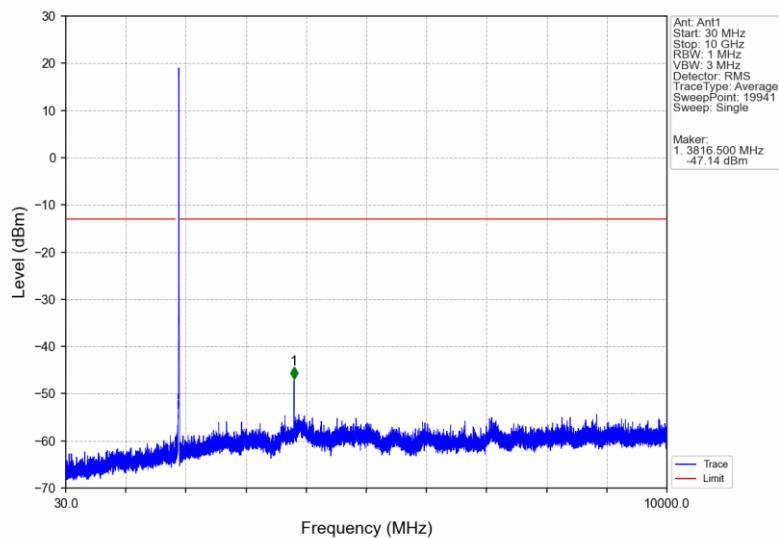


Band2_RMC_HCH_1907.6MHz_12.2kbps RMC_NTNV

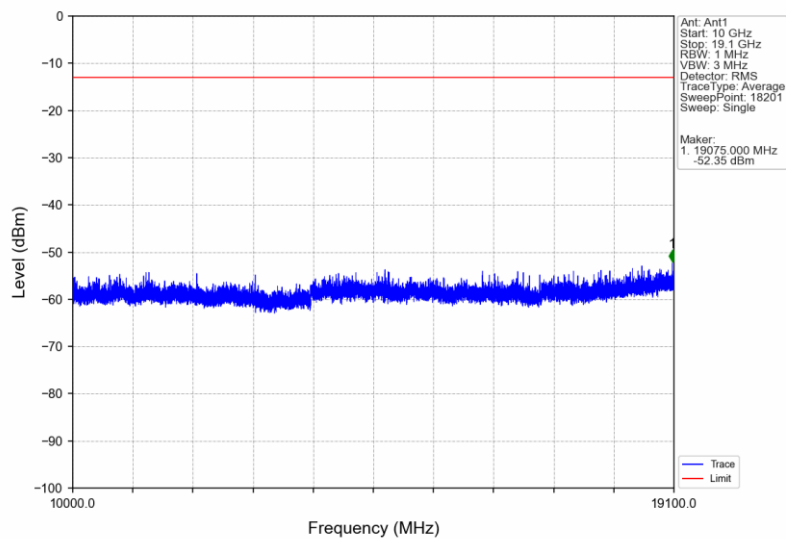


Compliance Certification Services (Kunshan) Inc. Shenzhen Branch

Report No.: FYCR2606000176AT

Band2_HSDPA_LCH_1852.4MHz_Subtest 1_NTNV

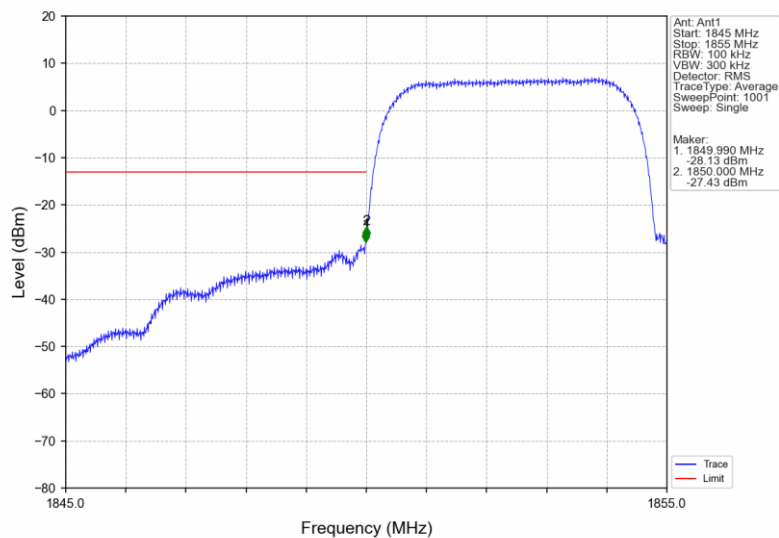


Band2_HSDPA_LCH_1852.4MHz_Subtest 1_NTNV

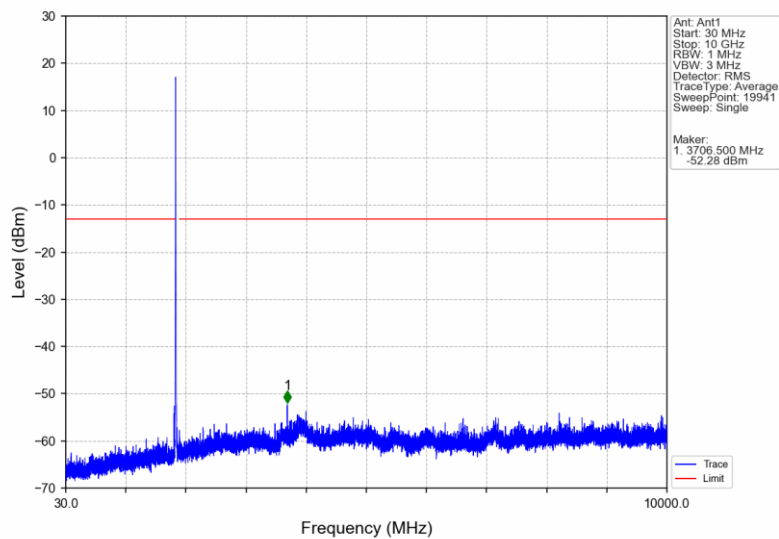


Compliance Certification Services (Kunshan) Inc. Shenzhen Branch

Report No.: FYCR2606000176AT

Band2_HSDPA_LCH_1852.4MHz_Subtest 1_NTNV

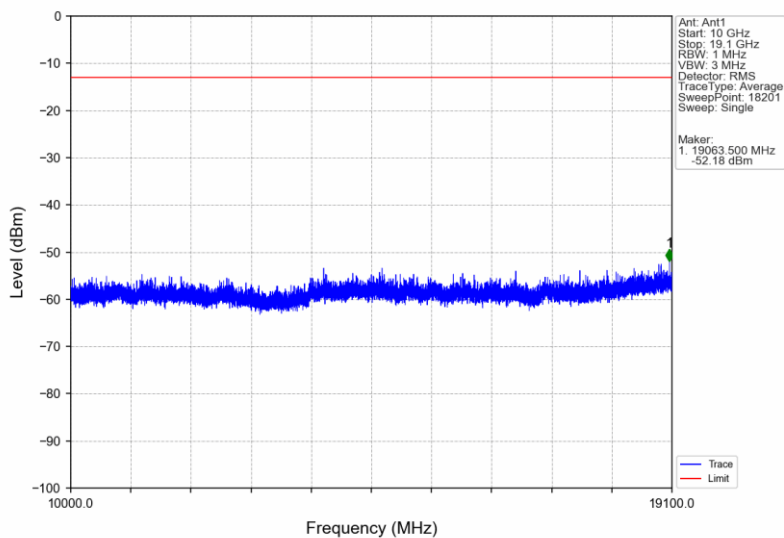


Band2_HSDPA_MCH_1880MHz_Subtest 1_NTNV

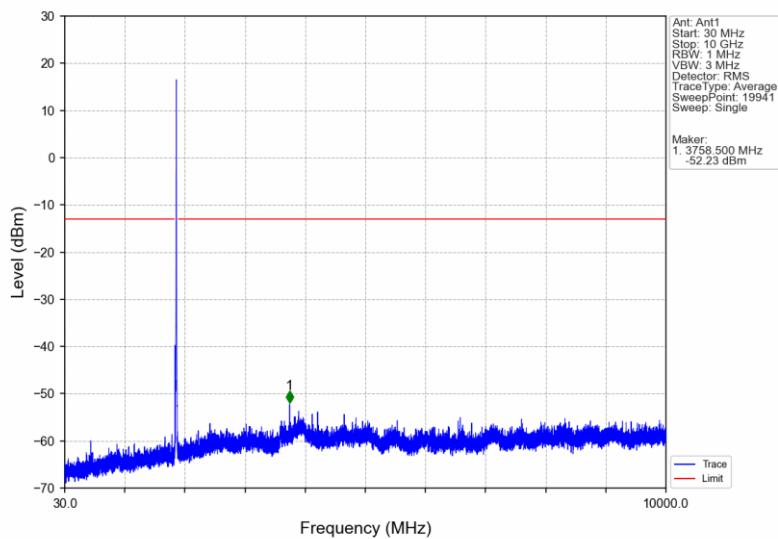


Compliance Certification Services (Kunshan) Inc. Shenzhen Branch

Report No.: FYCR2606000176AT

Band2_HSDPA_MCH_1880MHz_Subtest 1_NTNV

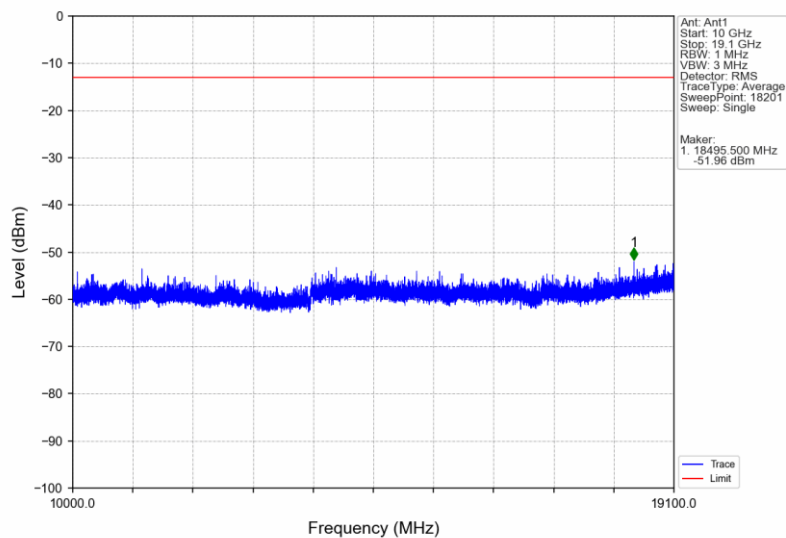


Band2_HSDPA_HCH_1907.6MHz_Subtest 1_NTNV

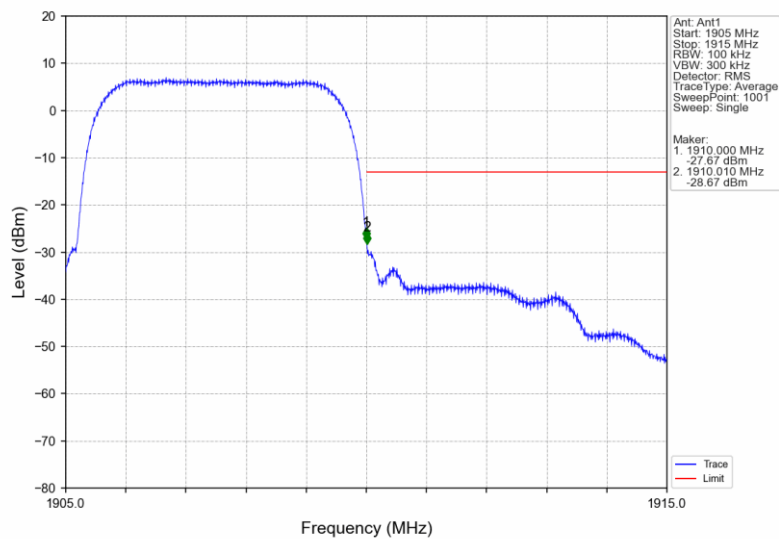


Compliance Certification Services (Kunshan) Inc. Shenzhen Branch

Report No.: FYCR2606000176AT

Band2_HSDPA_HCH_1907.6MHz_Subtest 1_NTNV

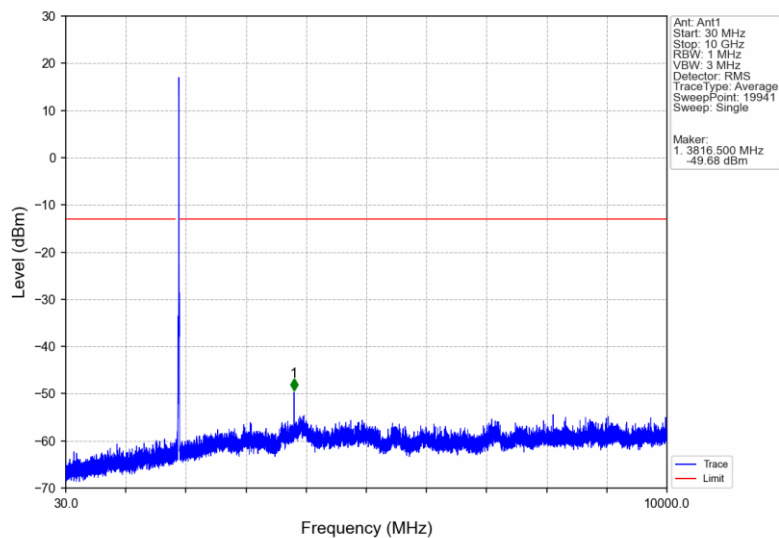


Band2_HSDPA_HCH_1907.6MHz_Subtest 1_NTNV

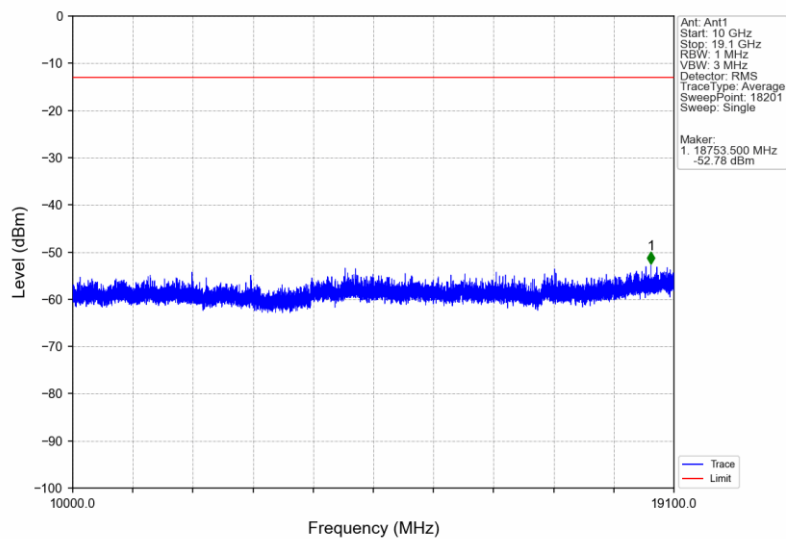


Compliance Certification Services (Kunshan) Inc. Shenzhen Branch

Report No.: FYCR2606000176AT

Band2_HSUPA_LCH_1852.4MHz_Subtest 1_NTNV

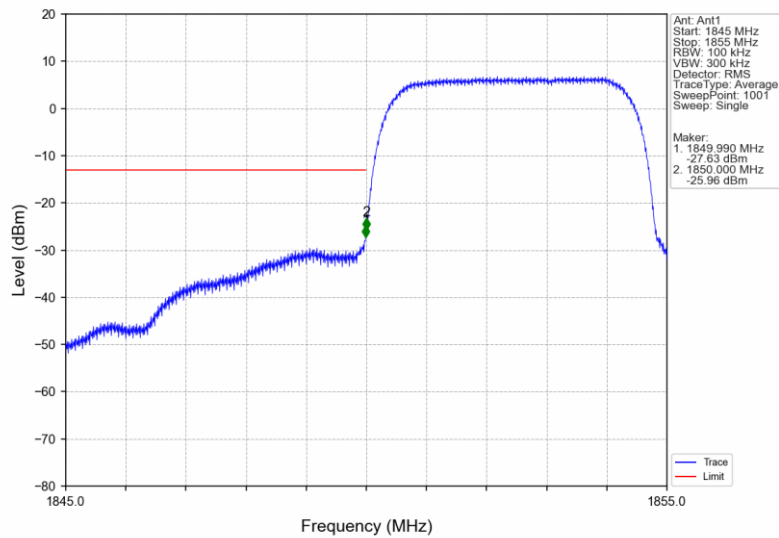


Band2_HSUPA_LCH_1852.4MHz_Subtest 1_NTNV

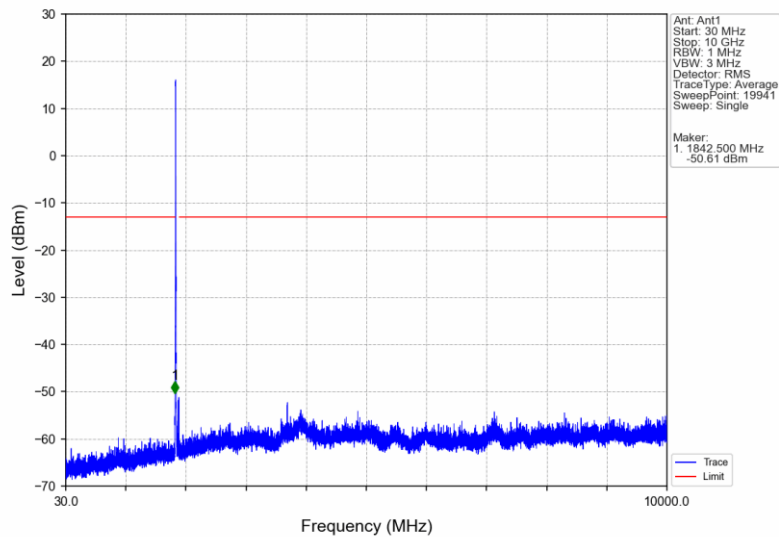


Compliance Certification Services (Kunshan) Inc. Shenzhen Branch

Report No.: FYCR2606000176AT

Band2_HSUPA_LCH_1852.4MHz_Subtest 1_NTNV

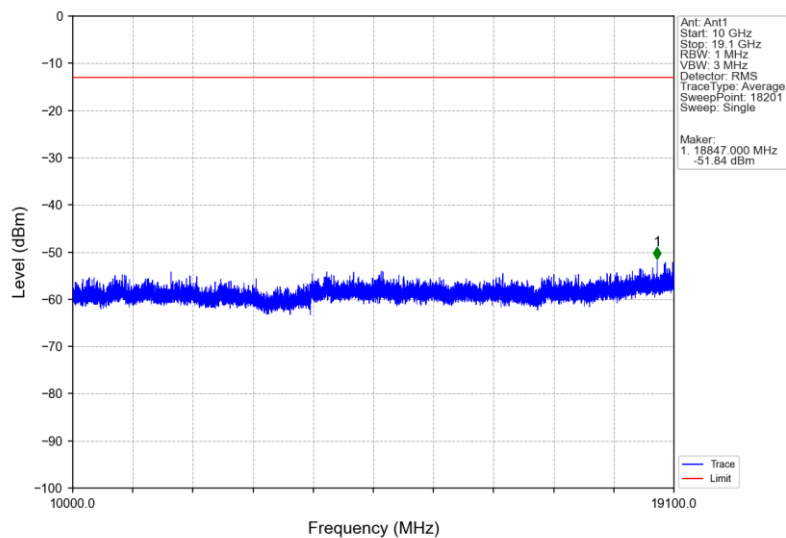


Band2_HSUPA_MCH_1880MHz_Subtest 1_NTNV

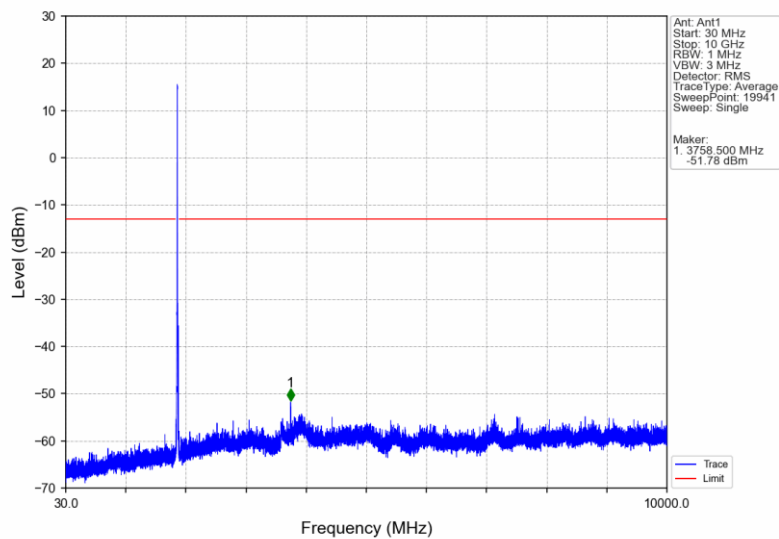


Compliance Certification Services (Kunshan) Inc. Shenzhen Branch

Report No.: FYCR2606000176AT

Band2_HSUPA_MCH_1880MHz_Subtest 1_NTNV

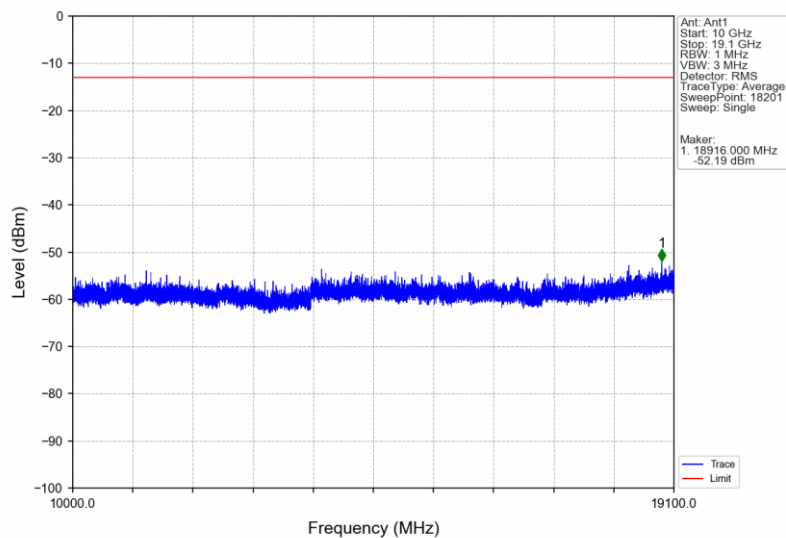


Band2_HSUPA_HCH_1907.6MHz_Subtest 1_NTNV

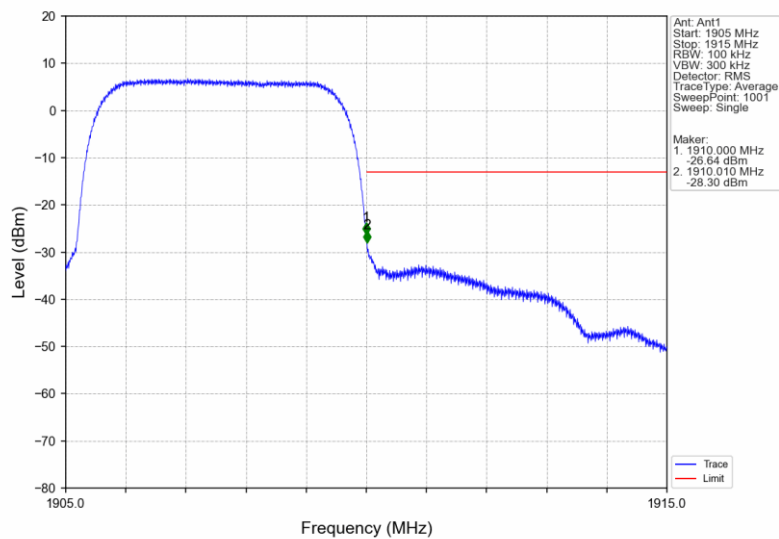


Compliance Certification Services (Kunshan) Inc. Shenzhen Branch

Report No.: FYCR2606000176AT

Band2_HSUPA_HCH_1907.6MHz_Subtest 1_NTNV

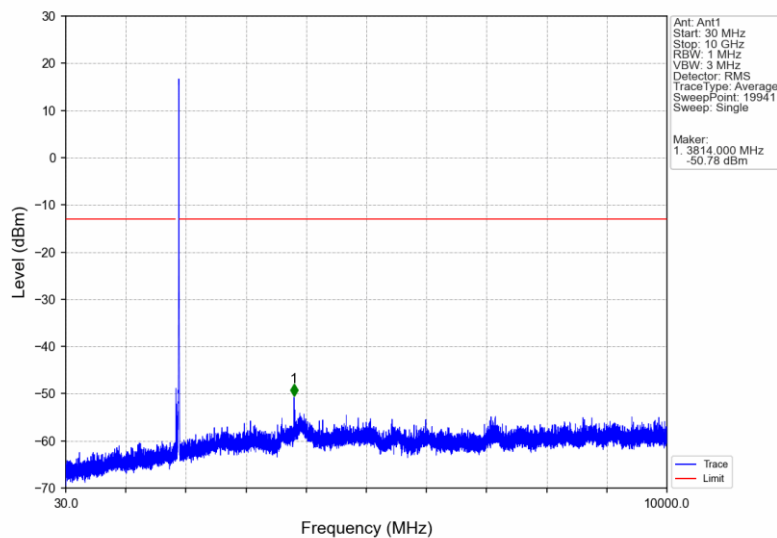

Band2_HSUPA_HCH_1907.6MHz_Subtest 1_NTNV

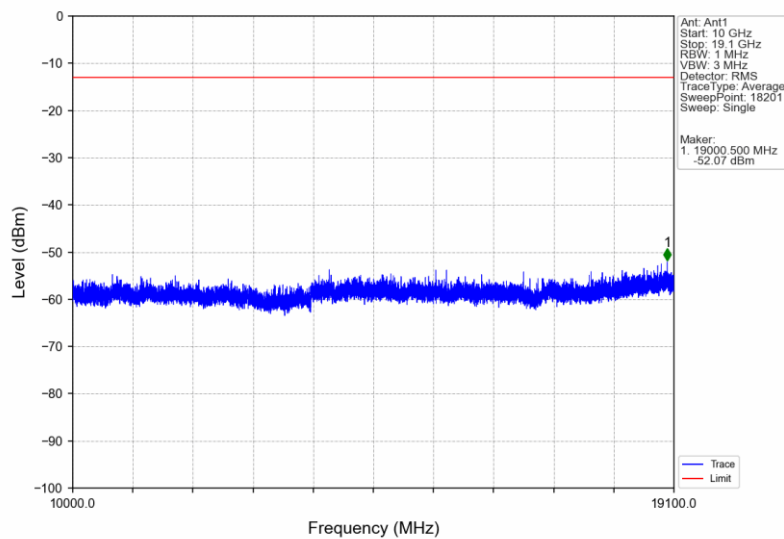

- End of the Appendix -