





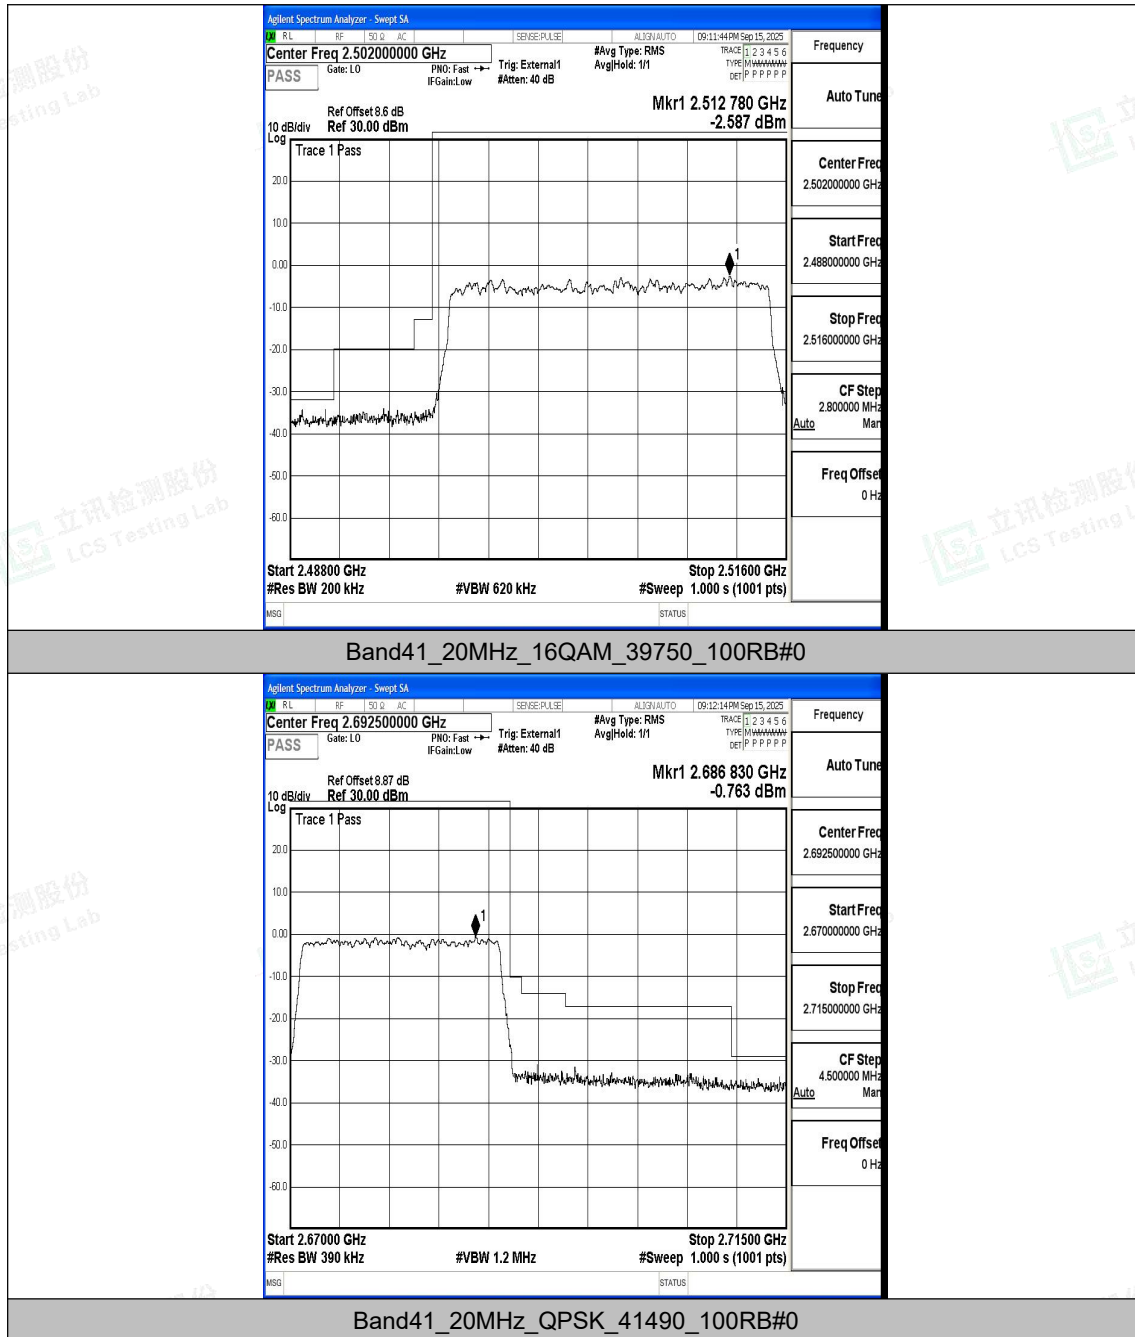

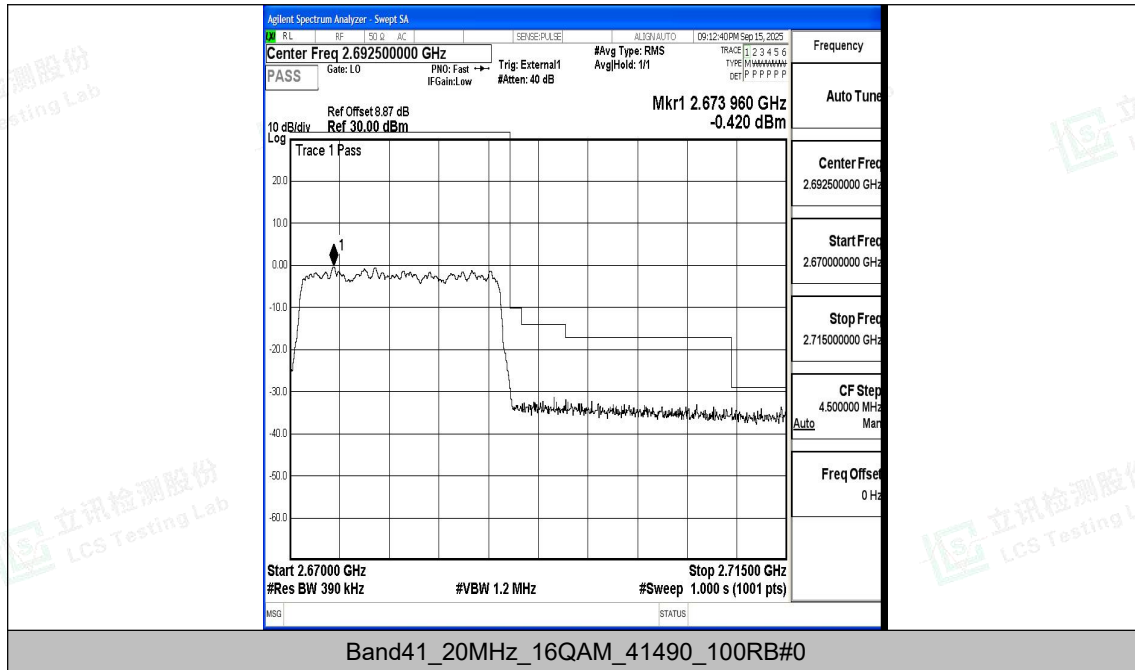

K.5 Conducted Spurious Emission

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Frequency Range	Result (dBm)	Verdict
Band41	5MHz	QPSK	39675	1RB#0	0.009~0.15	-66.09	PASS
Band41	5MHz	QPSK	39675	1RB#0	0.15~30	-61.58	PASS
Band41	5MHz	QPSK	39675	1RB#0	30~1000	-53.25	PASS
Band41	5MHz	QPSK	39675	1RB#0	1000~20000	-27.37	PASS
Band41	5MHz	QPSK	39675	1RB#0	20000~27000	-36.19	PASS
Band41	5MHz	16QAM	39675	1RB#0	0.009~0.15	-66.46	PASS
Band41	5MHz	16QAM	39675	1RB#0	0.15~30	-64.94	PASS
Band41	5MHz	16QAM	39675	1RB#0	30~1000	-53.26	PASS
Band41	5MHz	16QAM	39675	1RB#0	1000~20000	-27.30	PASS
Band41	5MHz	16QAM	39675	1RB#0	20000~27000	-36.62	PASS
Band41	5MHz	QPSK	40620	1RB#0	0.009~0.15	-66.07	PASS
Band41	5MHz	QPSK	40620	1RB#0	0.15~30	-50.21	PASS
Band41	5MHz	QPSK	40620	1RB#0	30~1000	-52.68	PASS
Band41	5MHz	QPSK	40620	1RB#0	1000~20000	-28.51	PASS
Band41	5MHz	QPSK	40620	1RB#0	20000~27000	-36.66	PASS
Band41	5MHz	16QAM	40620	1RB#0	0.009~0.15	-63.60	PASS
Band41	5MHz	16QAM	40620	1RB#0	0.15~30	-46.20	PASS
Band41	5MHz	16QAM	40620	1RB#0	30~1000	-52.91	PASS
Band41	5MHz	16QAM	40620	1RB#0	1000~20000	-27.98	PASS
Band41	5MHz	16QAM	40620	1RB#0	20000~27000	-36.53	PASS
Band41	5MHz	QPSK	41565	1RB#0	0.009~0.15	-67.47	PASS
Band41	5MHz	QPSK	41565	1RB#0	0.15~30	-64.63	PASS
Band41	5MHz	QPSK	41565	1RB#0	30~1000	-52.95	PASS
Band41	5MHz	QPSK	41565	1RB#0	1000~20000	-28.55	PASS
Band41	5MHz	QPSK	41565	1RB#0	20000~27000	-36.50	PASS
Band41	5MHz	16QAM	41565	1RB#0	0.009~0.15	-65.85	PASS
Band41	5MHz	16QAM	41565	1RB#0	0.15~30	-62.45	PASS
Band41	5MHz	16QAM	41565	1RB#0	30~1000	-52.29	PASS
Band41	5MHz	16QAM	41565	1RB#0	1000~20000	-27.68	PASS
Band41	5MHz	16QAM	41565	1RB#0	20000~27000	-35.85	PASS
Band41	10MHz	QPSK	39700	1RB#0	0.009~0.15	-65.96	PASS
Band41	10MHz	QPSK	39700	1RB#0	0.15~30	-63.57	PASS
Band41	10MHz	QPSK	39700	1RB#0	30~1000	-52.43	PASS
Band41	10MHz	QPSK	39700	1RB#0	1000~20000	-28.08	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	10MHz	QPSK	39700	1RB#0	20000~27000	-35.81	PASS
Band41	10MHz	16QAM	39700	1RB#0	0.009~0.15	-64.01	PASS
Band41	10MHz	16QAM	39700	1RB#0	0.15~30	-62.10	PASS
Band41	10MHz	16QAM	39700	1RB#0	30~1000	-52.85	PASS
Band41	10MHz	16QAM	39700	1RB#0	1000~20000	-28.19	PASS
Band41	10MHz	16QAM	39700	1RB#0	20000~27000	-36.05	PASS
Band41	10MHz	QPSK	40620	1RB#0	0.009~0.15	-66.18	PASS
Band41	10MHz	QPSK	40620	1RB#0	0.15~30	-48.86	PASS
Band41	10MHz	QPSK	40620	1RB#0	30~1000	-52.77	PASS
Band41	10MHz	QPSK	40620	1RB#0	1000~20000	-28.42	PASS
Band41	10MHz	QPSK	40620	1RB#0	20000~27000	-35.57	PASS
Band41	10MHz	16QAM	40620	1RB#0	0.009~0.15	-65.46	PASS
Band41	10MHz	16QAM	40620	1RB#0	0.15~30	-47.04	PASS
Band41	10MHz	16QAM	40620	1RB#0	30~1000	-53.22	PASS
Band41	10MHz	16QAM	40620	1RB#0	1000~20000	-27.51	PASS
Band41	10MHz	16QAM	40620	1RB#0	20000~27000	-35.94	PASS
Band41	10MHz	QPSK	41540	1RB#0	0.009~0.15	-64.51	PASS
Band41	10MHz	QPSK	41540	1RB#0	0.15~30	-62.73	PASS
Band41	10MHz	QPSK	41540	1RB#0	30~1000	-52.38	PASS
Band41	10MHz	QPSK	41540	1RB#0	1000~20000	-27.79	PASS
Band41	10MHz	QPSK	41540	1RB#0	20000~27000	-36.06	PASS
Band41	10MHz	16QAM	41540	1RB#0	0.009~0.15	-64.46	PASS
Band41	10MHz	16QAM	41540	1RB#0	0.15~30	-63.32	PASS
Band41	10MHz	16QAM	41540	1RB#0	30~1000	-52.74	PASS
Band41	10MHz	16QAM	41540	1RB#0	1000~20000	-28.65	PASS
Band41	10MHz	16QAM	41540	1RB#0	20000~27000	-35.96	PASS
Band41	15MHz	QPSK	39725	1RB#0	0.009~0.15	-64.15	PASS
Band41	15MHz	QPSK	39725	1RB#0	0.15~30	-63.13	PASS
Band41	15MHz	QPSK	39725	1RB#0	30~1000	-52.60	PASS
Band41	15MHz	QPSK	39725	1RB#0	1000~20000	-28.08	PASS
Band41	15MHz	QPSK	39725	1RB#0	20000~27000	-35.10	PASS
Band41	15MHz	16QAM	39725	1RB#0	0.009~0.15	-65.62	PASS
Band41	15MHz	16QAM	39725	1RB#0	0.15~30	-62.62	PASS
Band41	15MHz	16QAM	39725	1RB#0	30~1000	-51.34	PASS
Band41	15MHz	16QAM	39725	1RB#0	1000~20000	-28.30	PASS
Band41	15MHz	16QAM	39725	1RB#0	20000~27000	-35.58	PASS
Band41	15MHz	QPSK	40620	1RB#0	0.009~0.15	-65.35	PASS
Band41	15MHz	QPSK	40620	1RB#0	0.15~30	-48.64	PASS
Band41	15MHz	QPSK	40620	1RB#0	30~1000	-51.63	PASS
Band41	15MHz	QPSK	40620	1RB#0	1000~20000	-27.59	PASS
Band41	15MHz	QPSK	40620	1RB#0	20000~27000	-35.96	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	15MHz	16QAM	40620	1RB#0	0.009~0.15	-64.83	PASS
Band41	15MHz	16QAM	40620	1RB#0	0.15~30	-48.50	PASS
Band41	15MHz	16QAM	40620	1RB#0	30~1000	-53.38	PASS
Band41	15MHz	16QAM	40620	1RB#0	1000~20000	-28.49	PASS
Band41	15MHz	16QAM	40620	1RB#0	20000~27000	-35.96	PASS
Band41	15MHz	QPSK	41515	1RB#0	0.009~0.15	-66.10	PASS
Band41	15MHz	QPSK	41515	1RB#0	0.15~30	-64.41	PASS
Band41	15MHz	QPSK	41515	1RB#0	30~1000	-53.34	PASS
Band41	15MHz	QPSK	41515	1RB#0	1000~20000	-28.08	PASS
Band41	15MHz	QPSK	41515	1RB#0	20000~27000	-36.61	PASS
Band41	15MHz	16QAM	41515	1RB#0	0.009~0.15	-66.71	PASS
Band41	15MHz	16QAM	41515	1RB#0	0.15~30	-60.59	PASS
Band41	15MHz	16QAM	41515	1RB#0	30~1000	-52.63	PASS
Band41	15MHz	16QAM	41515	1RB#0	1000~20000	-28.36	PASS
Band41	15MHz	16QAM	41515	1RB#0	20000~27000	-36.03	PASS
Band41	20MHz	QPSK	39750	1RB#0	0.009~0.15	-64.57	PASS
Band41	20MHz	QPSK	39750	1RB#0	0.15~30	-64.75	PASS
Band41	20MHz	QPSK	39750	1RB#0	30~1000	-52.58	PASS
Band41	20MHz	QPSK	39750	1RB#0	1000~20000	-28.57	PASS
Band41	20MHz	QPSK	39750	1RB#0	20000~27000	-36.43	PASS
Band41	20MHz	16QAM	39750	1RB#0	0.009~0.15	-64.62	PASS
Band41	20MHz	16QAM	39750	1RB#0	0.15~30	-61.94	PASS
Band41	20MHz	16QAM	39750	1RB#0	30~1000	-52.06	PASS
Band41	20MHz	16QAM	39750	1RB#0	1000~20000	-28.16	PASS
Band41	20MHz	16QAM	39750	1RB#0	20000~27000	-35.71	PASS
Band41	20MHz	QPSK	40620	1RB#0	0.009~0.15	-64.99	PASS
Band41	20MHz	QPSK	40620	1RB#0	0.15~30	-49.59	PASS
Band41	20MHz	QPSK	40620	1RB#0	30~1000	-52.61	PASS
Band41	20MHz	QPSK	40620	1RB#0	1000~20000	-28.09	PASS
Band41	20MHz	QPSK	40620	1RB#0	20000~27000	-36.02	PASS
Band41	20MHz	16QAM	40620	1RB#0	0.009~0.15	-65.58	PASS
Band41	20MHz	16QAM	40620	1RB#0	0.15~30	-48.72	PASS
Band41	20MHz	16QAM	40620	1RB#0	30~1000	-53.09	PASS
Band41	20MHz	16QAM	40620	1RB#0	1000~20000	-28.04	PASS
Band41	20MHz	16QAM	40620	1RB#0	20000~27000	-35.27	PASS
Band41	20MHz	QPSK	41490	1RB#0	0.009~0.15	-65.86	PASS
Band41	20MHz	QPSK	41490	1RB#0	0.15~30	-61.28	PASS
Band41	20MHz	QPSK	41490	1RB#0	30~1000	-53.61	PASS
Band41	20MHz	QPSK	41490	1RB#0	1000~20000	-28.13	PASS
Band41	20MHz	QPSK	41490	1RB#0	20000~27000	-36.40	PASS
Band41	20MHz	16QAM	41490	1RB#0	0.009~0.15	-65.55	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	20MHz	16QAM	41490	1RB#0	0.15~30	-64.65	PASS
Band41	20MHz	16QAM	41490	1RB#0	30~1000	-53.13	PASS
Band41	20MHz	16QAM	41490	1RB#0	1000~20000	-28.48	PASS
Band41	20MHz	16QAM	41490	1RB#0	20000~27000	-35.93	PASS

Test Graphs

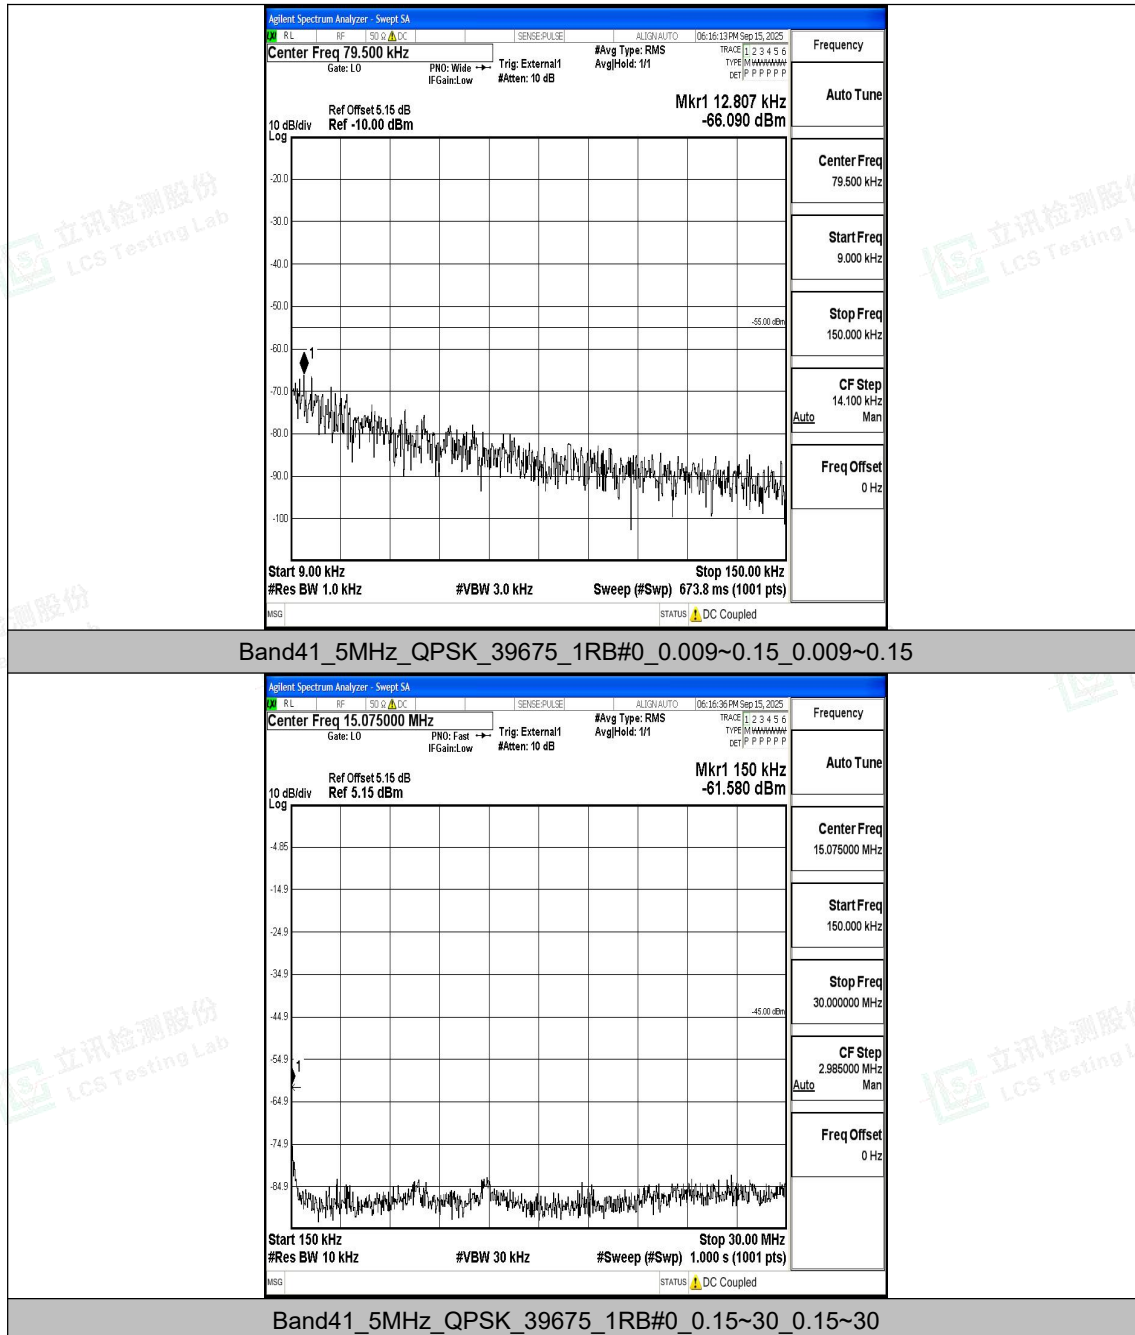

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

