





Duty Cycle NVNT 1-DH5 2402MHz Ant1

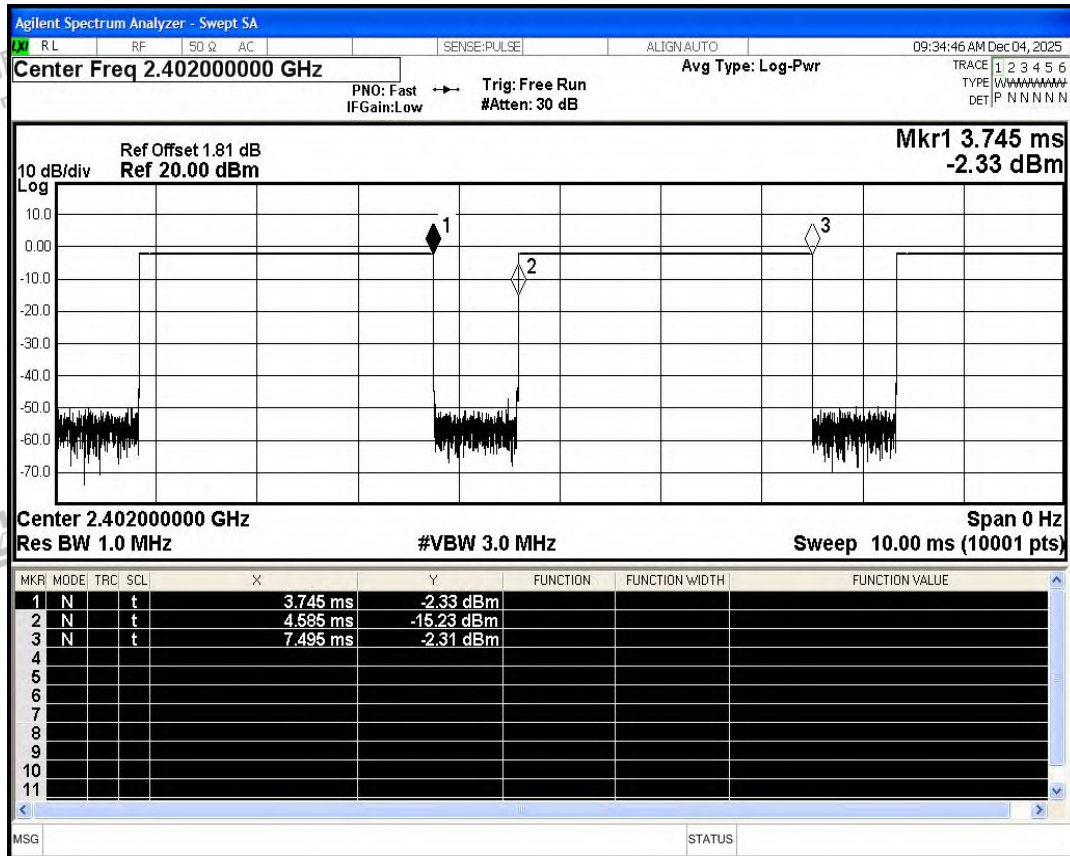

Duty Cycle NVNT 1-DH5 2441MHz Ant1

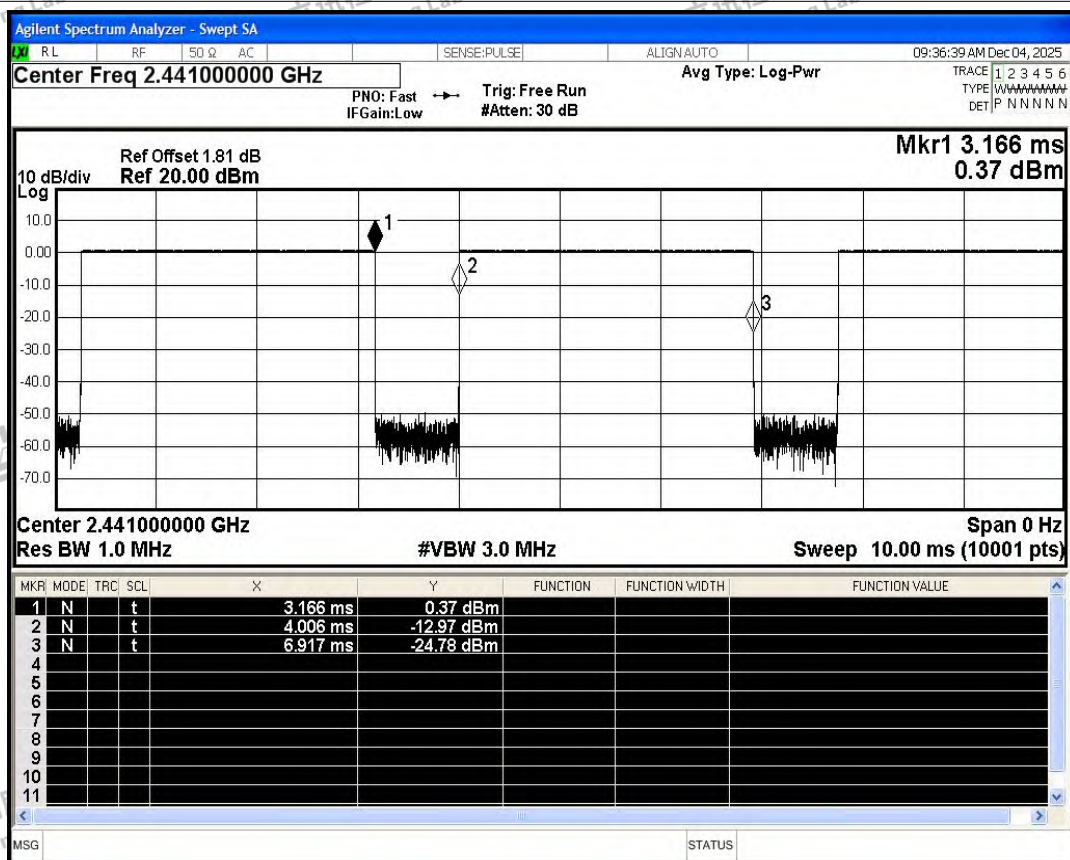


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

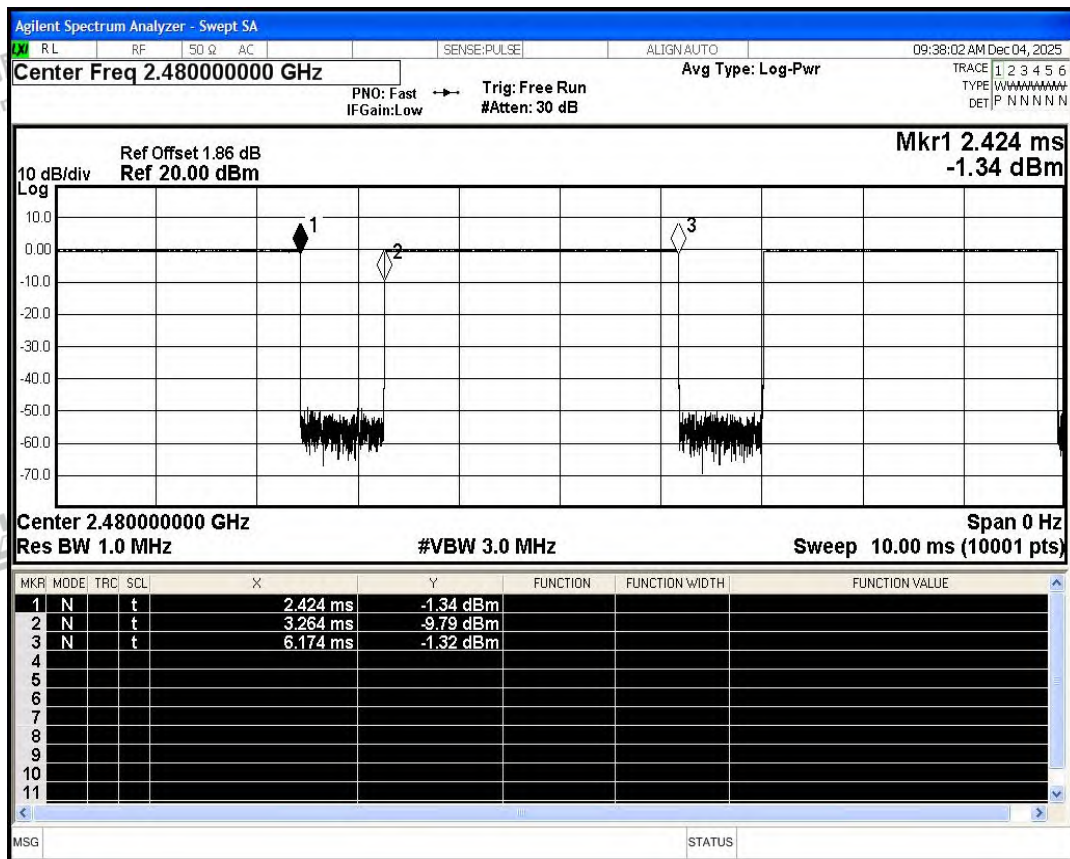

Duty Cycle NVNT 1-DH5 2480MHz Ant1

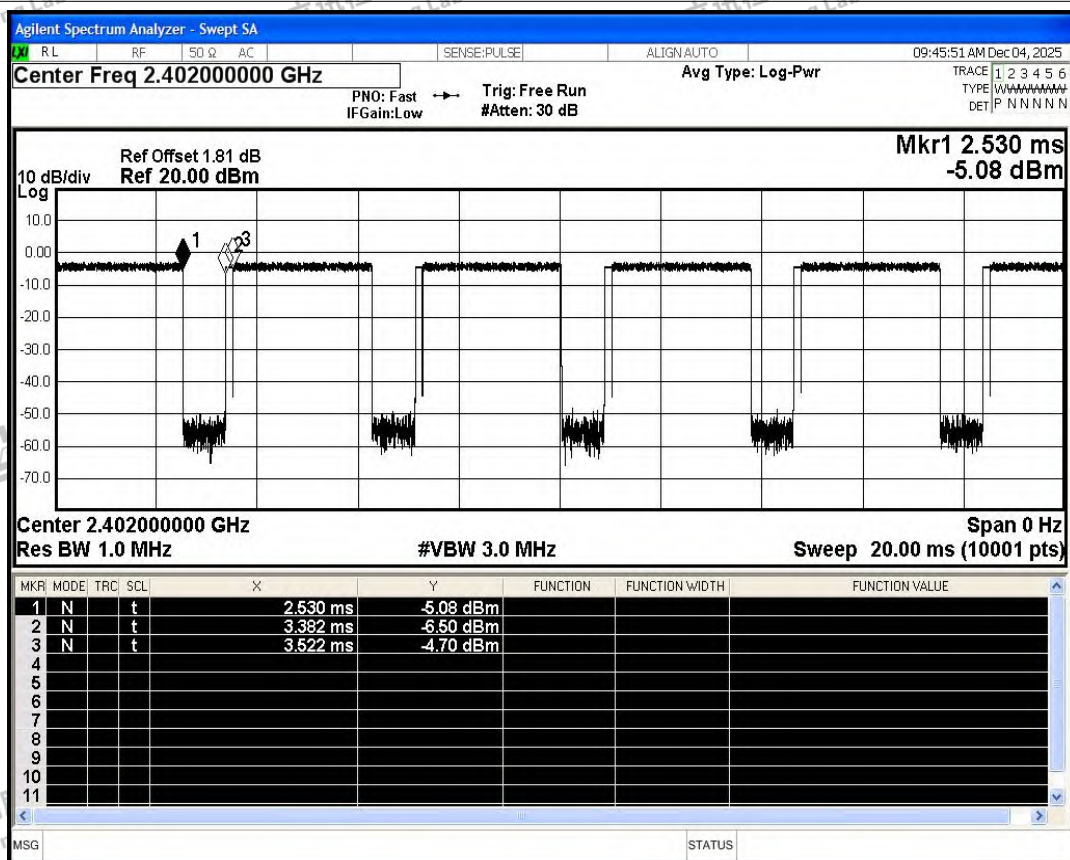

Duty Cycle NVNT 2-DH5 2402MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

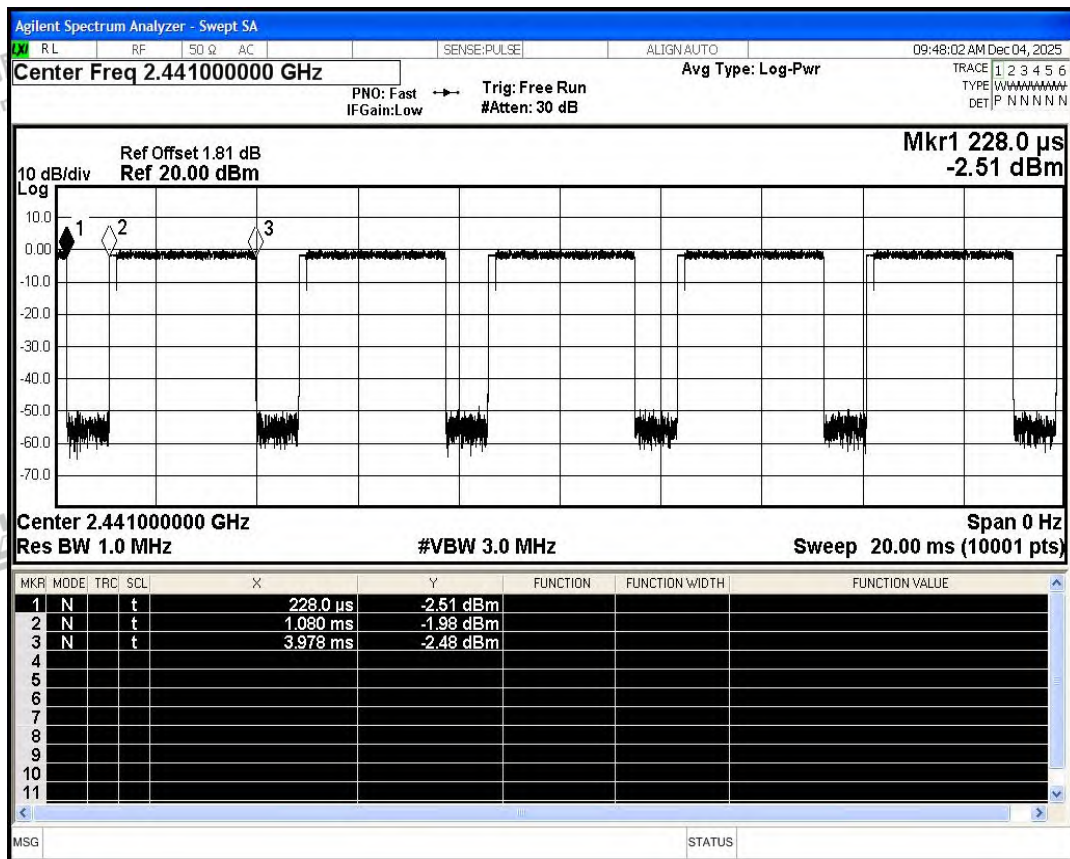

Duty Cycle NVNT 2-DH5 2441MHz Ant1

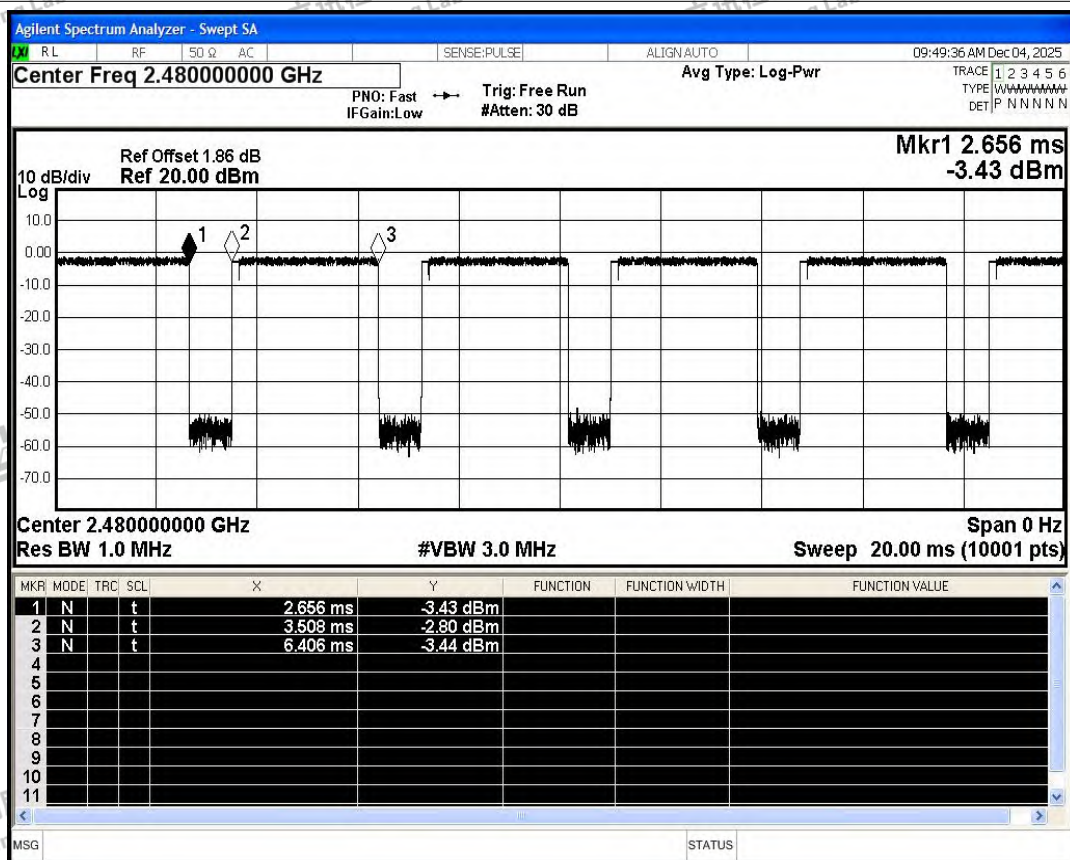

Duty Cycle NVNT 2-DH5 2480MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

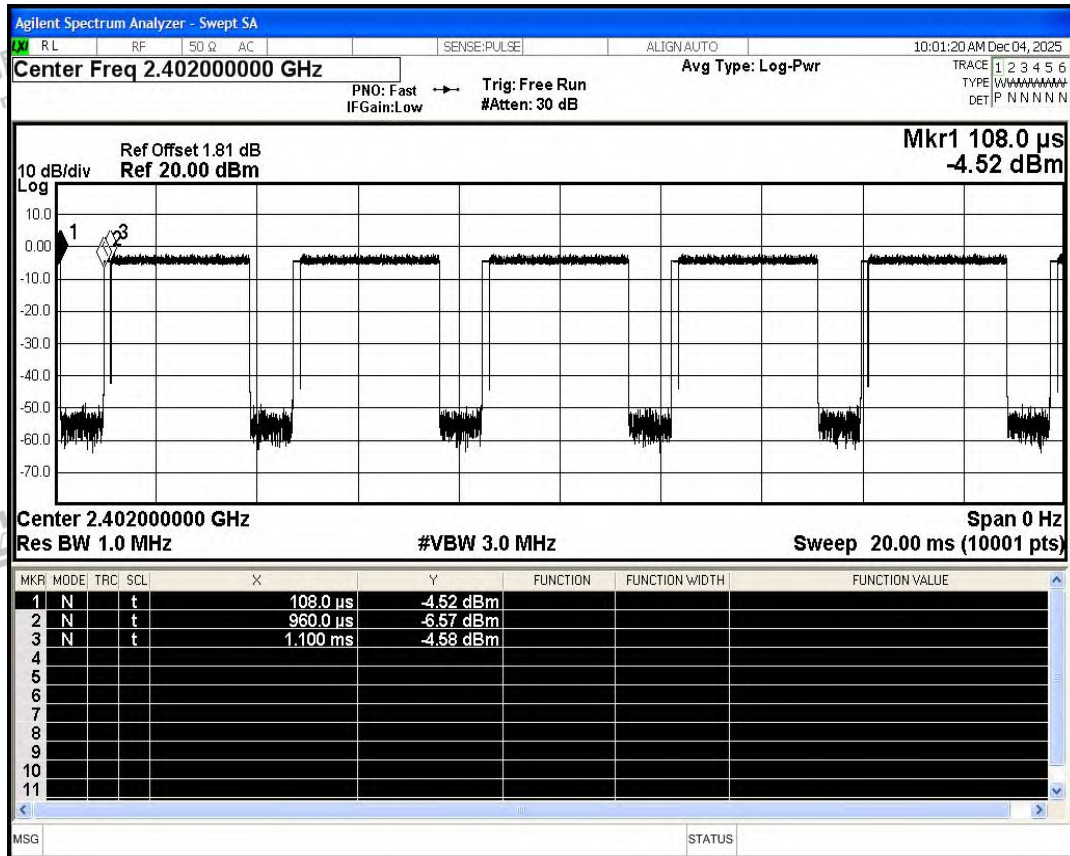

Duty Cycle NVNT 3-DH5 2402MHz Ant1

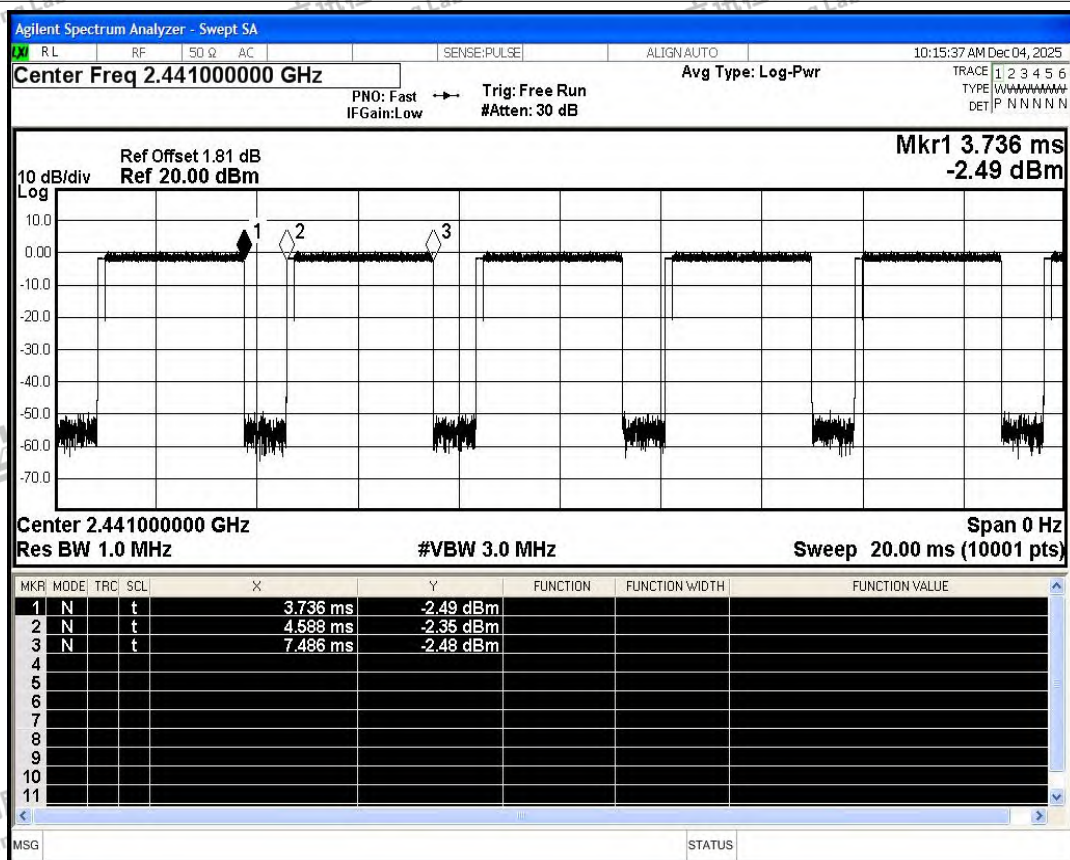

Duty Cycle NVNT 3-DH5 2441MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

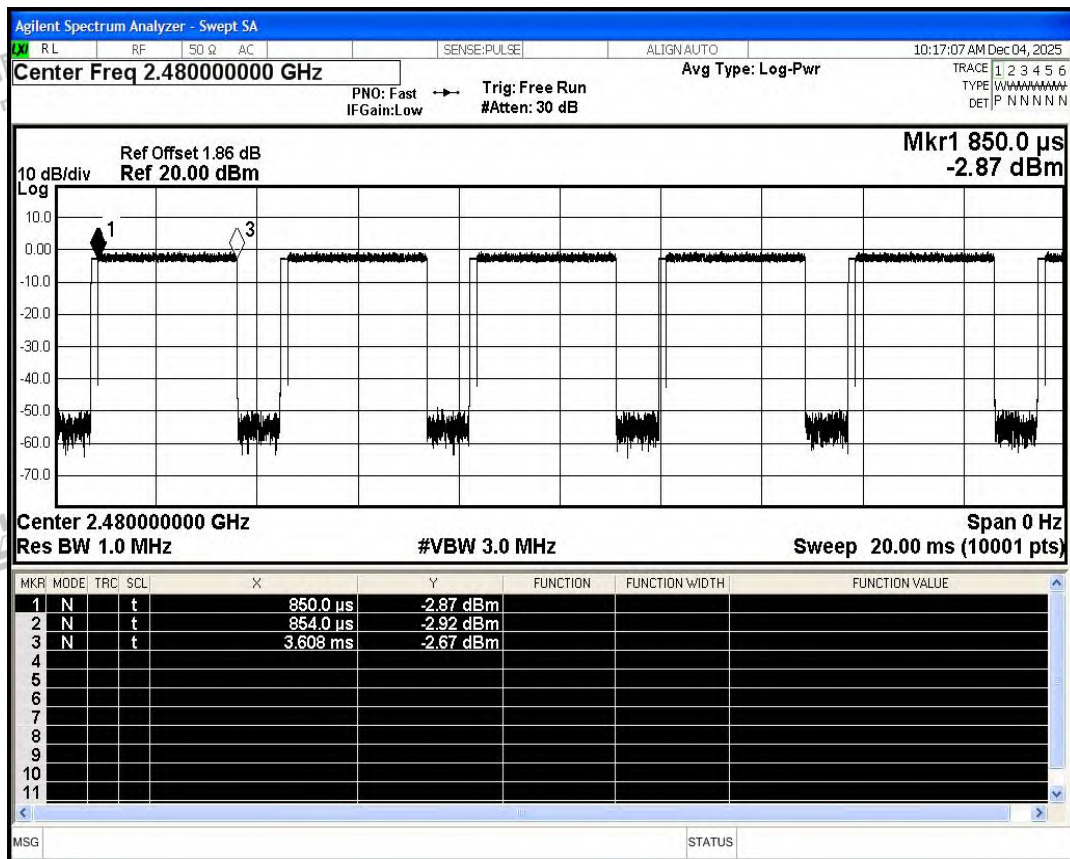

Duty Cycle NVNT 3-DH5 2480MHz Ant1





A.9 Restrict Band

Condition	Mode	Frequency (MHz)	Antenna	Hopping Mode	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	1-DH5	2402	Ant1	No-Hopping	2310	-51	2	46.26	Peak	74	Pass
NVNT	1-DH5	2402	Ant1	No-Hopping	2310	-60.55	2	36.71	Average	54	Pass
NVNT	1-DH5	2402	Ant1	No-Hopping	2367.504	-47.7	2	49.56	Peak	74	Pass
NVNT	1-DH5	2402	Ant1	No-Hopping	2379.984	-60	2	37.26	Average	54	Pass
NVNT	1-DH5	2402	Ant1	No-Hopping	2390	-50.19	2	47.07	Peak	74	Pass
NVNT	1-DH5	2402	Ant1	No-Hopping	2390	-60.08	2	37.18	Average	54	Pass
NVNT	1-DH5	2480	Ant1	No-Hopping	2483.5	-49.39	2	47.87	Peak	74	Pass
NVNT	1-DH5	2480	Ant1	No-Hopping	2483.5	-59.41	2	37.85	Average	54	Pass
NVNT	1-DH5	2480	Ant1	No-Hopping	2485	-45.28	2	51.98	Peak	74	Pass
NVNT	1-DH5	2480	Ant1	No-Hopping	2483.536	-59.39	2	37.87	Average	54	Pass
NVNT	1-DH5	2480	Ant1	No-Hopping	2500	-50.19	2	47.07	Peak	74	Pass
NVNT	1-DH5	2480	Ant1	No-Hopping	2500	-59.81	2	37.45	Average	54	Pass
NVNT	2-DH5	2402	Ant1	No-Hopping	2310	-50.42	2	46.84	Peak	74	Pass
NVNT	2-DH5	2402	Ant1	No-Hopping	2310	-59.4	2	37.86	Average	54	Pass
NVNT	2-DH5	2402	Ant1	No-Hopping	2345.904	-47.48	2	49.78	Peak	74	Pass
NVNT	2-DH5	2402	Ant1	No-Hopping	2372.784	-57.9	2	39.36	Average	54	Pass
NVNT	2-DH5	2402	Ant1	No-Hopping	2390	-50.66	2	46.6	Peak	74	Pass
NVNT	2-DH5	2402	Ant1	No-Hopping	2390	-58.65	2	38.61	Average	54	Pass
NVNT	2-DH5	2480	Ant1	No-Hopping	2483.5	-51.04	2	46.22	Peak	74	Pass
NVNT	2-DH5	2480	Ant1	No-Hopping	2483.5	-59.23	2	38.03	Average	54	Pass
NVNT	2-DH5	2480	Ant1	No-Hopping	2485.816	-47.54	2	49.72	Peak	74	Pass
NVNT	2-DH5	2480	Ant1	No-Hopping	2483.536	-59.22	2	38.04	Average	54	Pass
NVNT	2-DH5	2480	Ant1	No-Hopping	2500	-50.49	2	46.77	Peak	74	Pass
NVNT	2-DH5	2480	Ant1	No-Hopping	2500	-59.88	2	37.38	Average	54	Pass
NVNT	3-DH5	2402	Ant1	No-Hopping	2310	-50.82	2	46.44	Peak	74	Pass
NVNT	3-DH5	2402	Ant1	No-Hopping	2310	-59.09	2	38.17	Average	54	Pass
NVNT	3-DH5	2402	Ant1	No-Hopping	2313.936	-46.57	2	50.69	Peak	74	Pass
NVNT	3-DH5	2402	Ant1	No-Hopping	2328.048	-57.99	2	39.27	Average	54	Pass
NVNT	3-DH5	2402	Ant1	No-Hopping	2390	-50.34	2	46.92	Peak	74	Pass
NVNT	3-DH5	2402	Ant1	No-Hopping	2390	-58.57	2	38.69	Average	54	Pass
NVNT	3-DH5	2480	Ant1	No-Hopping	2483.5	-49.81	2	47.45	Peak	74	Pass
NVNT	3-DH5	2480	Ant1	No-Hopping	2483.5	-49.36	2	47.9	Average	54	Pass
NVNT	3-DH5	2480	Ant1	No-Hopping	2496.376	-47.19	2	50.07	Peak	74	Pass
NVNT	3-DH5	2480	Ant1	No-Hopping	2487.28	-48.58	2	48.68	Average	54	Pass
NVNT	3-DH5	2480	Ant1	No-Hopping	2500	-50.41	2	46.85	Peak	74	Pass
NVNT	3-DH5	2480	Ant1	No-Hopping	2500	-53.15	2	44.11	Average	54	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

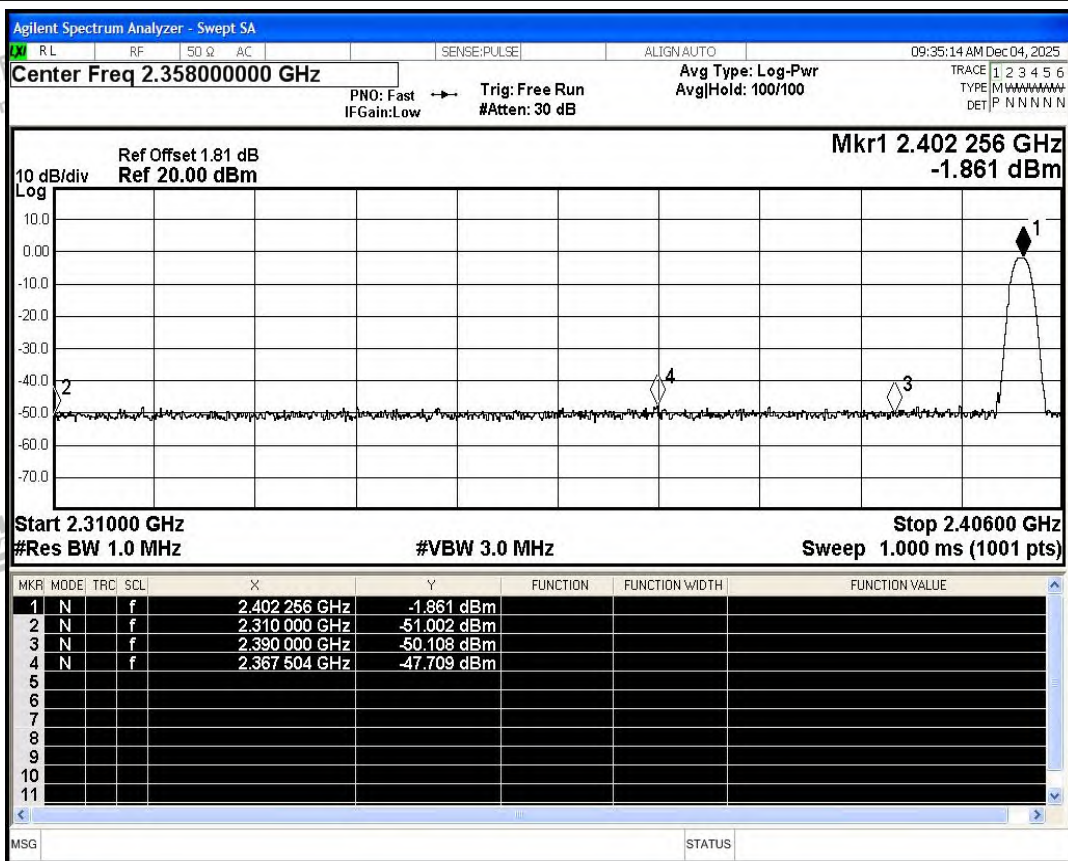

Restrict Band NVNT 1-DH5 2402MHz Ant1 No-Hopping Peak

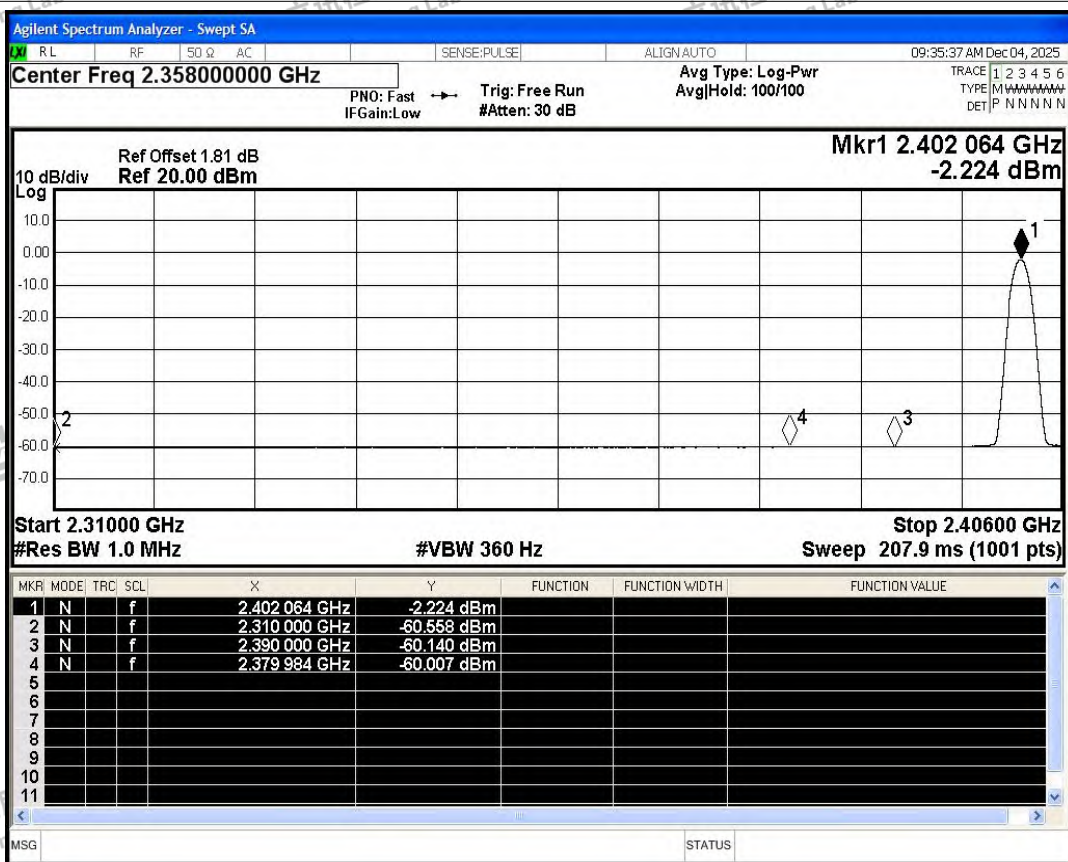

Restrict Band NVNT 1-DH5 2402MHz Ant1 No-Hopping Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

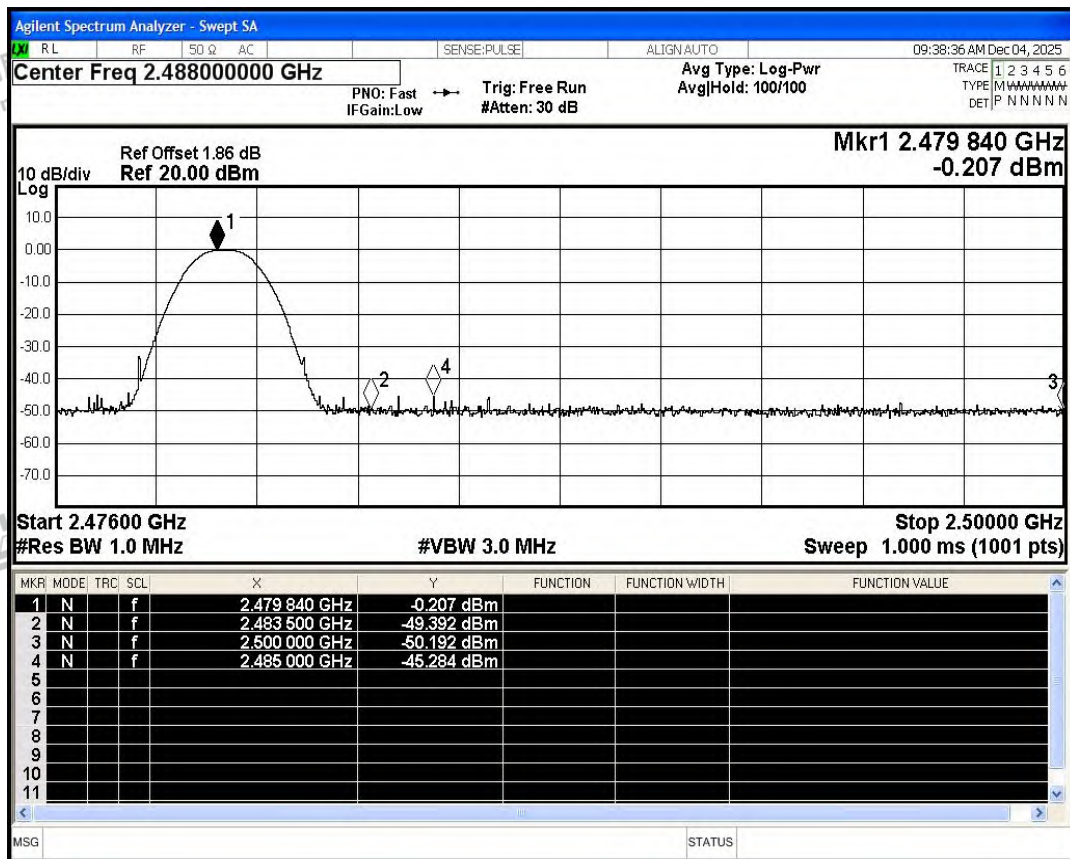

Restrict Band NVNT 1-DH5 2480MHz Ant1 No-Hopping Peak

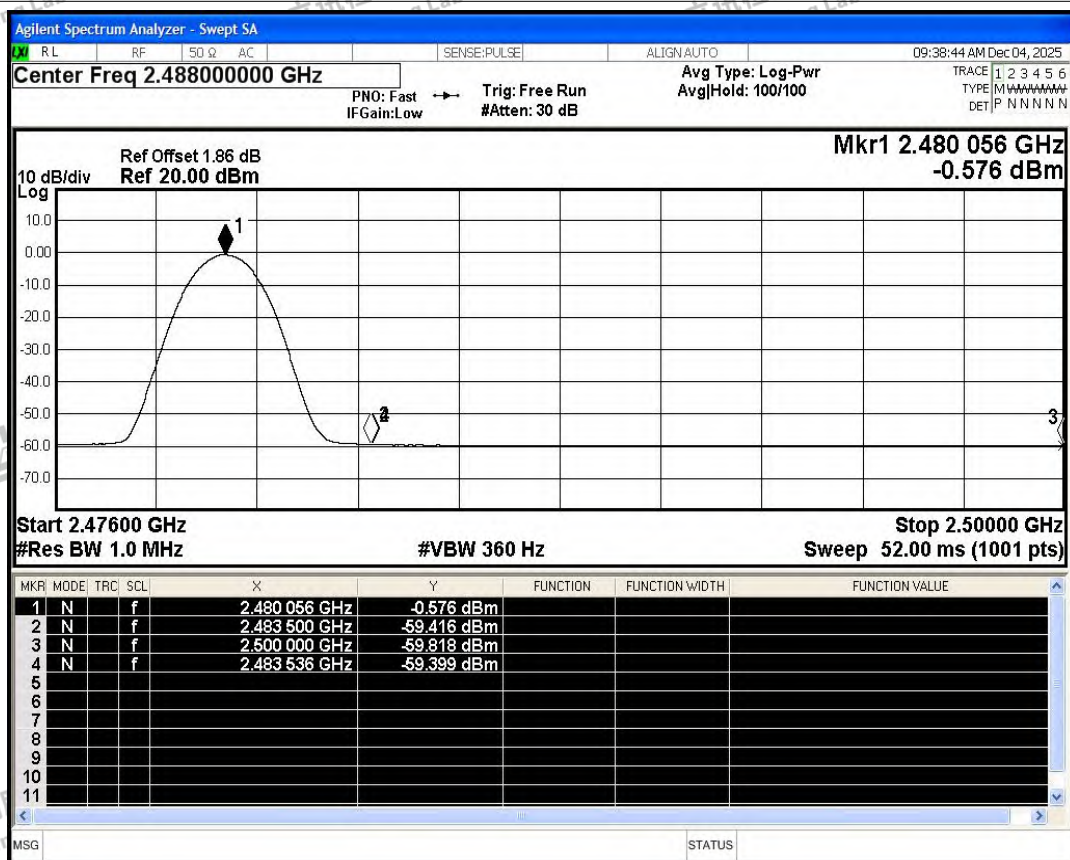

Restrict Band NVNT 1-DH5 2480MHz Ant1 No-Hopping Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

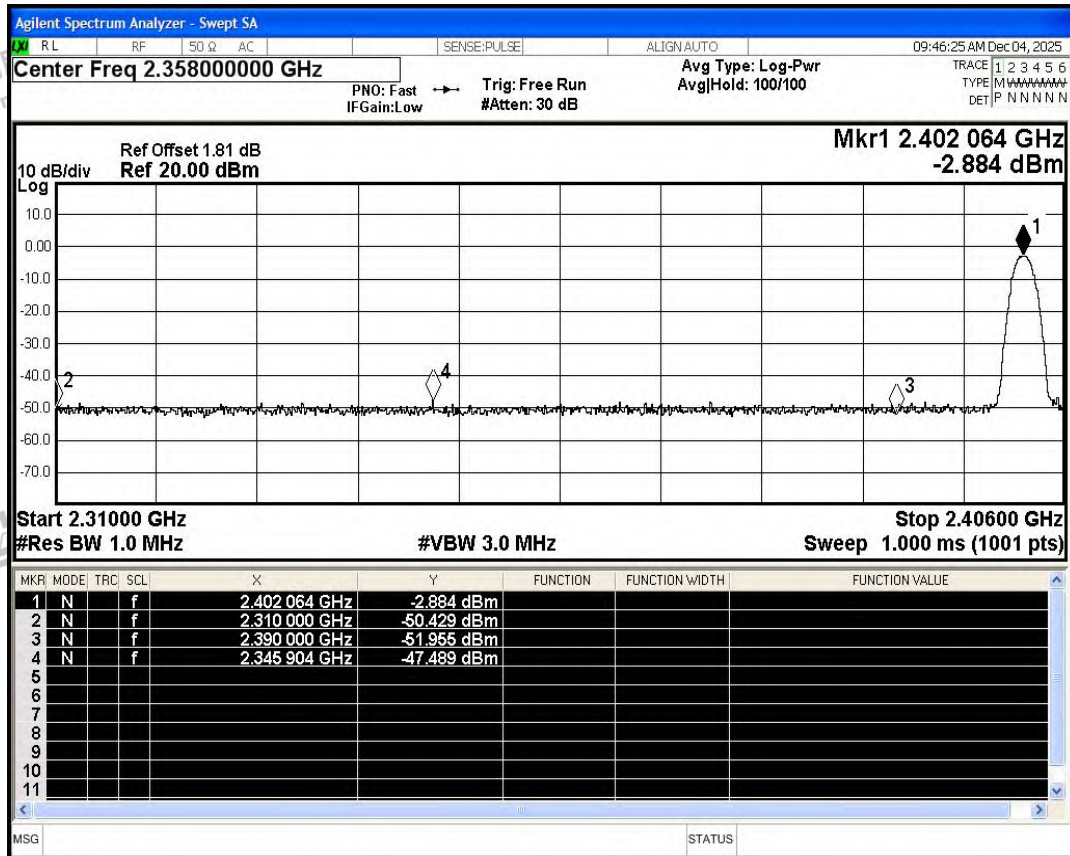

Restrict Band NVNT 2-DH5 2402MHz Ant1 No-Hopping Peak

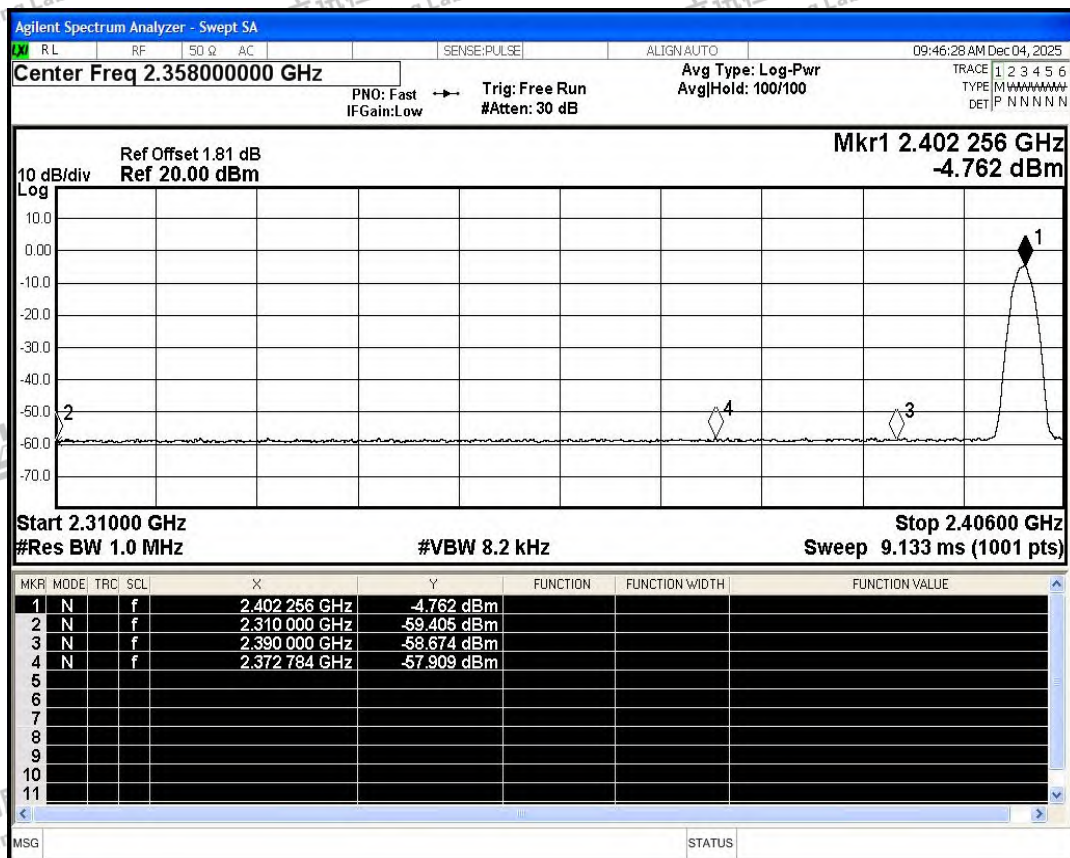

Restrict Band NVNT 2-DH5 2402MHz Ant1 No-Hopping Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

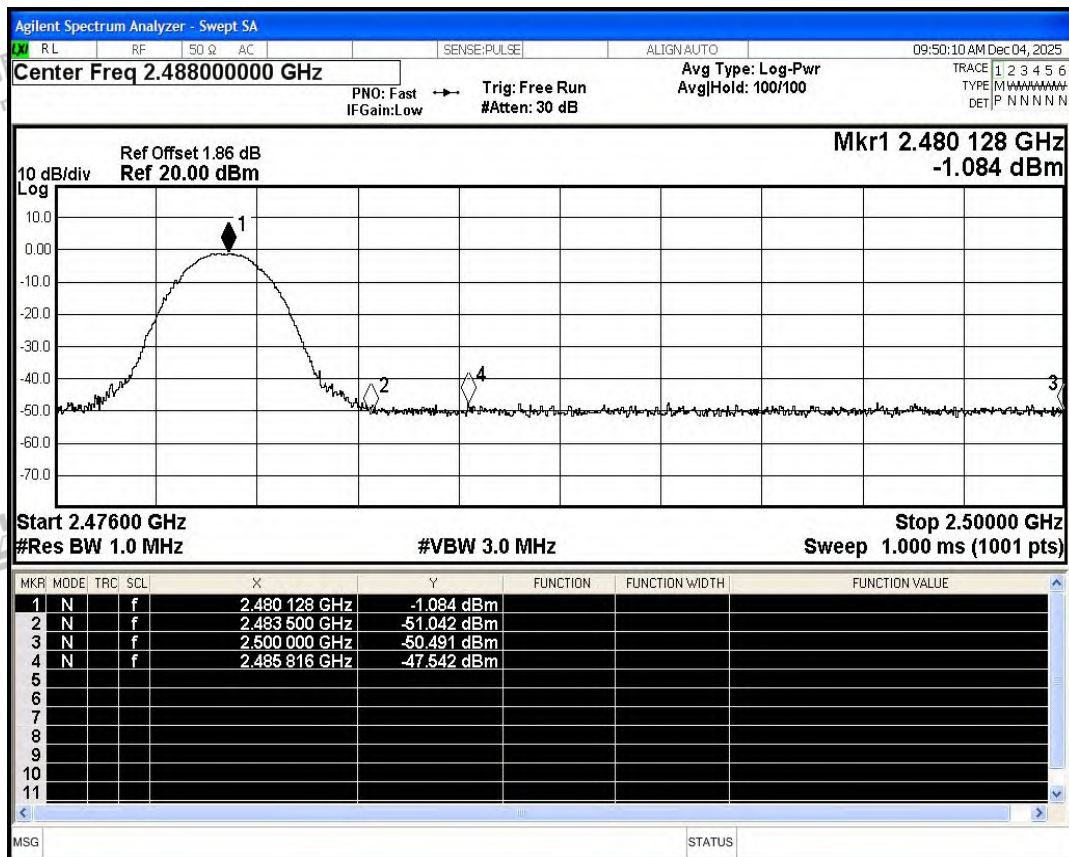

Restrict Band NVNT 2-DH5 2480MHz Ant1 No-Hopping Peak

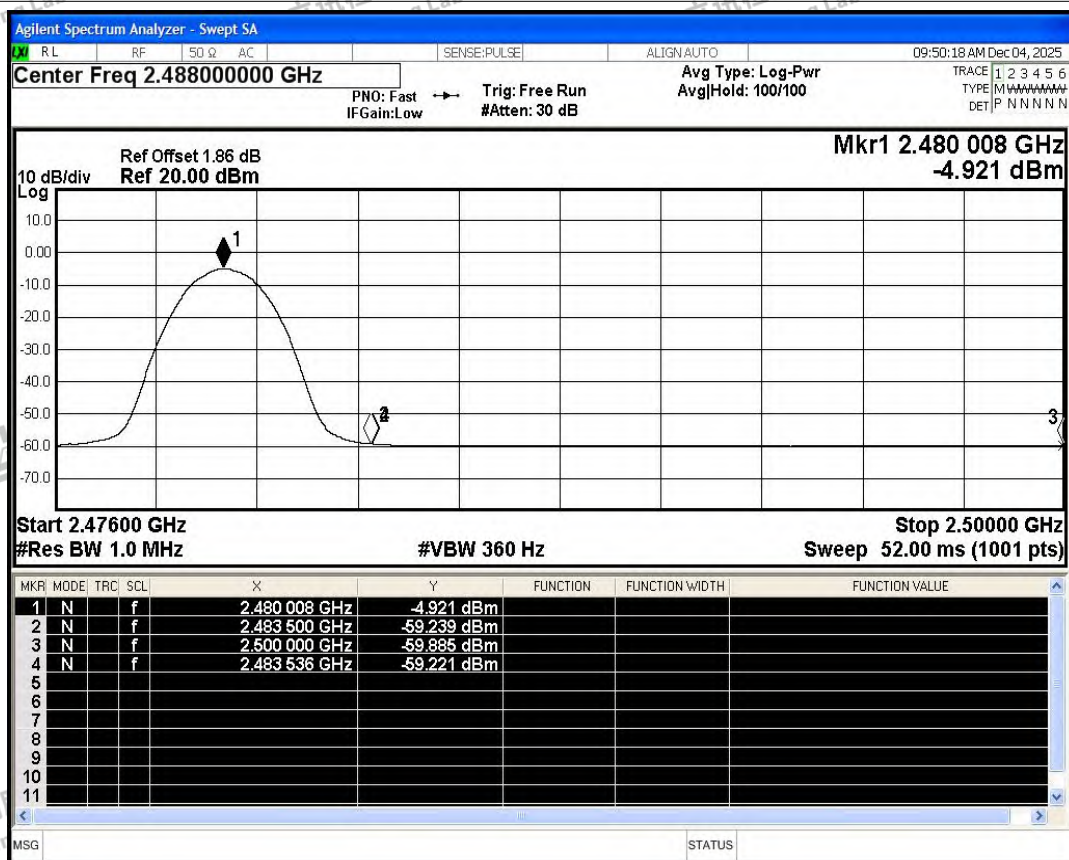

Restrict Band NVNT 2-DH5 2480MHz Ant1 No-Hopping Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

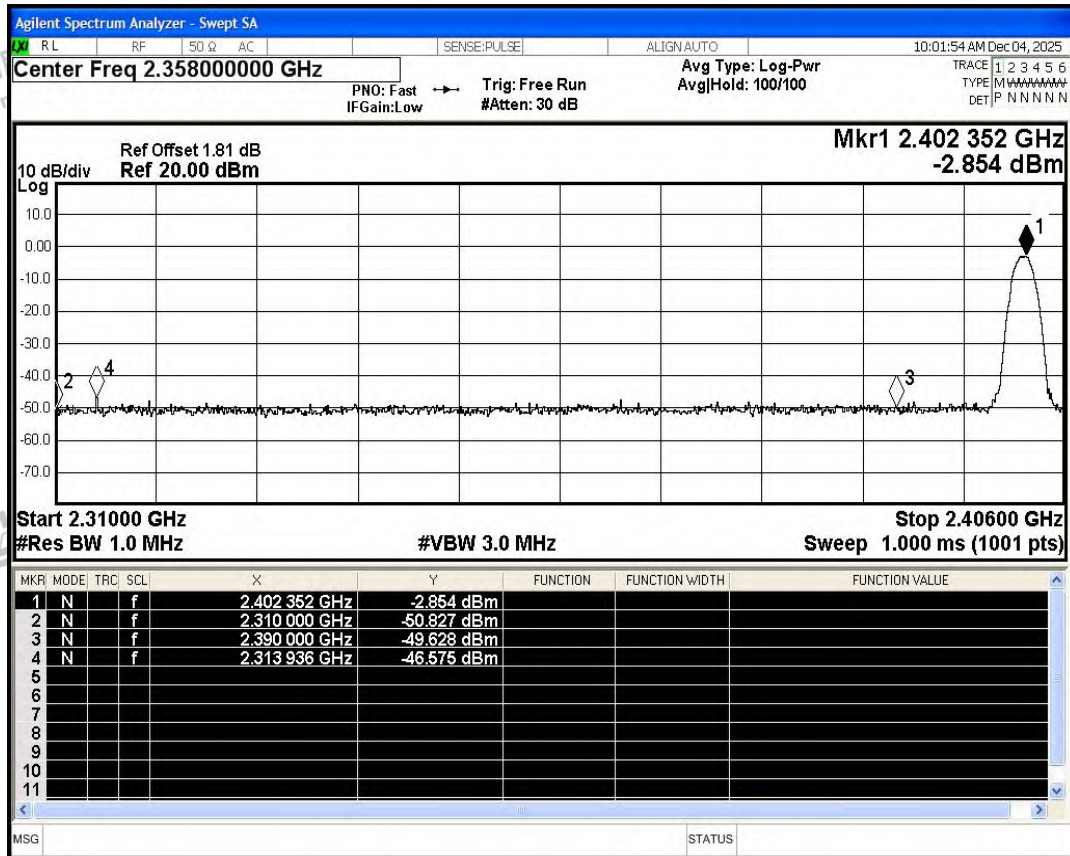

Restrict Band NVNT 3-DH5 2402MHz Ant1 No-Hopping Peak

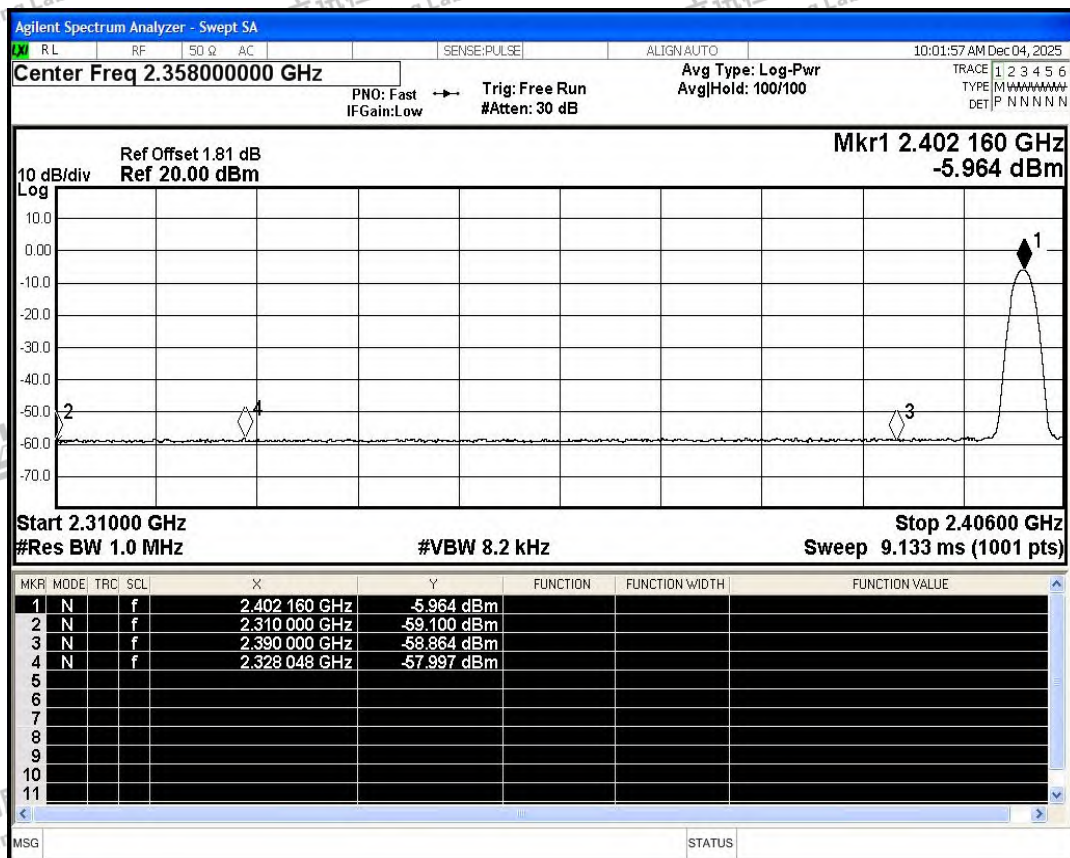

Restrict Band NVNT 3-DH5 2402MHz Ant1 No-Hopping Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

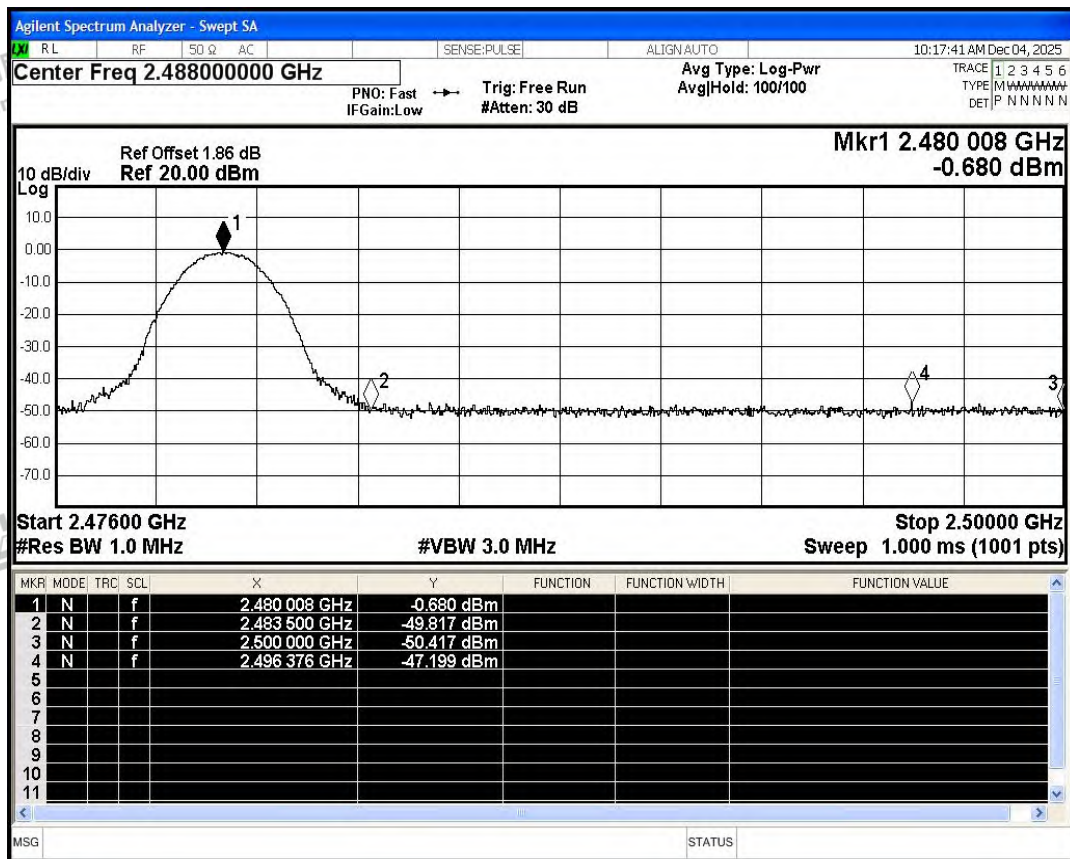

Restrict Band NVNT 3-DH5 2480MHz Ant1 No-Hopping Peak

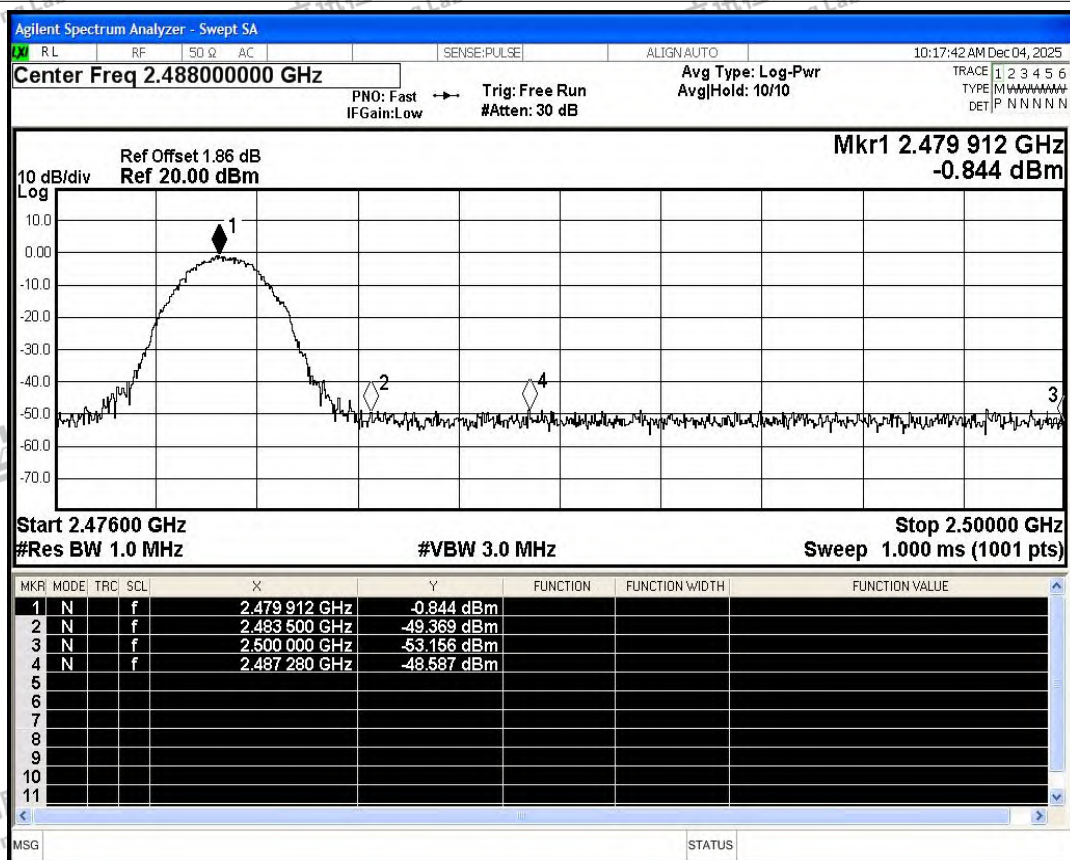

Restrict Band NVNT 3-DH5 2480MHz Ant1 No-Hopping Average



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity