




SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 291 of 1085



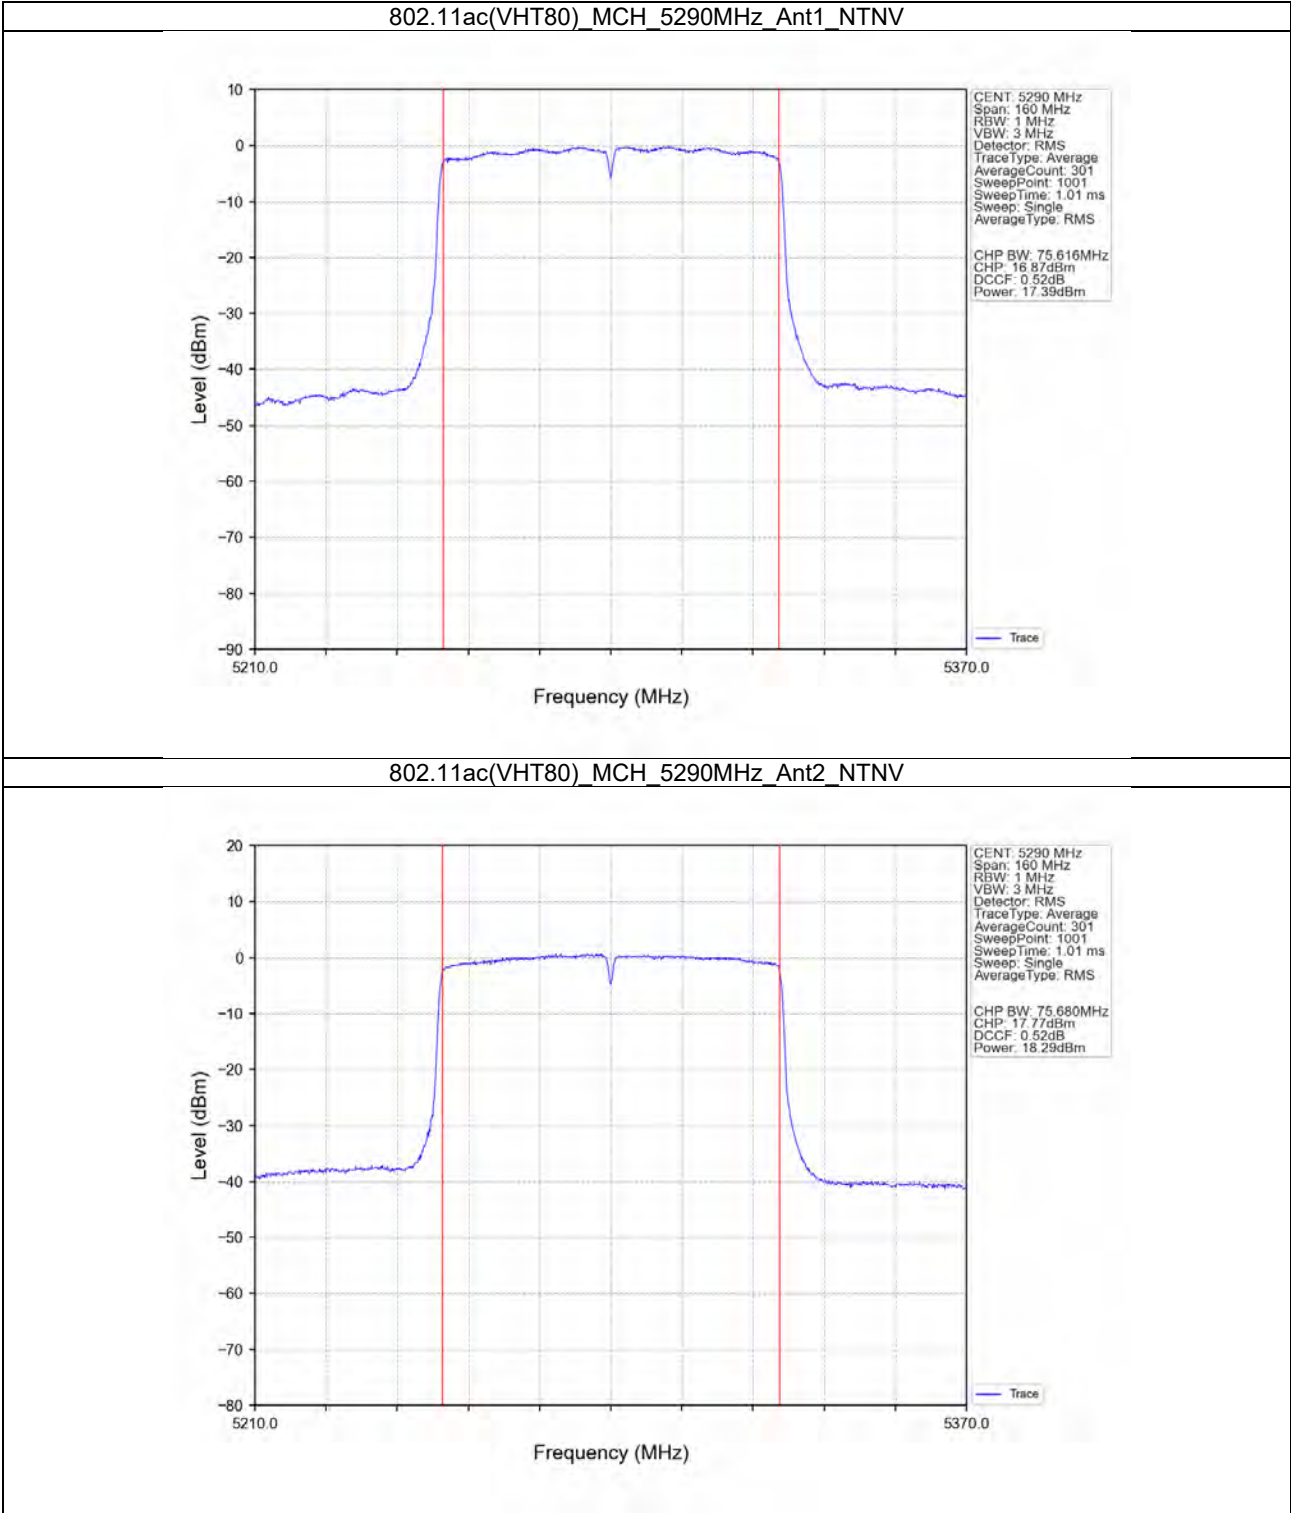

SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 292 of 1085

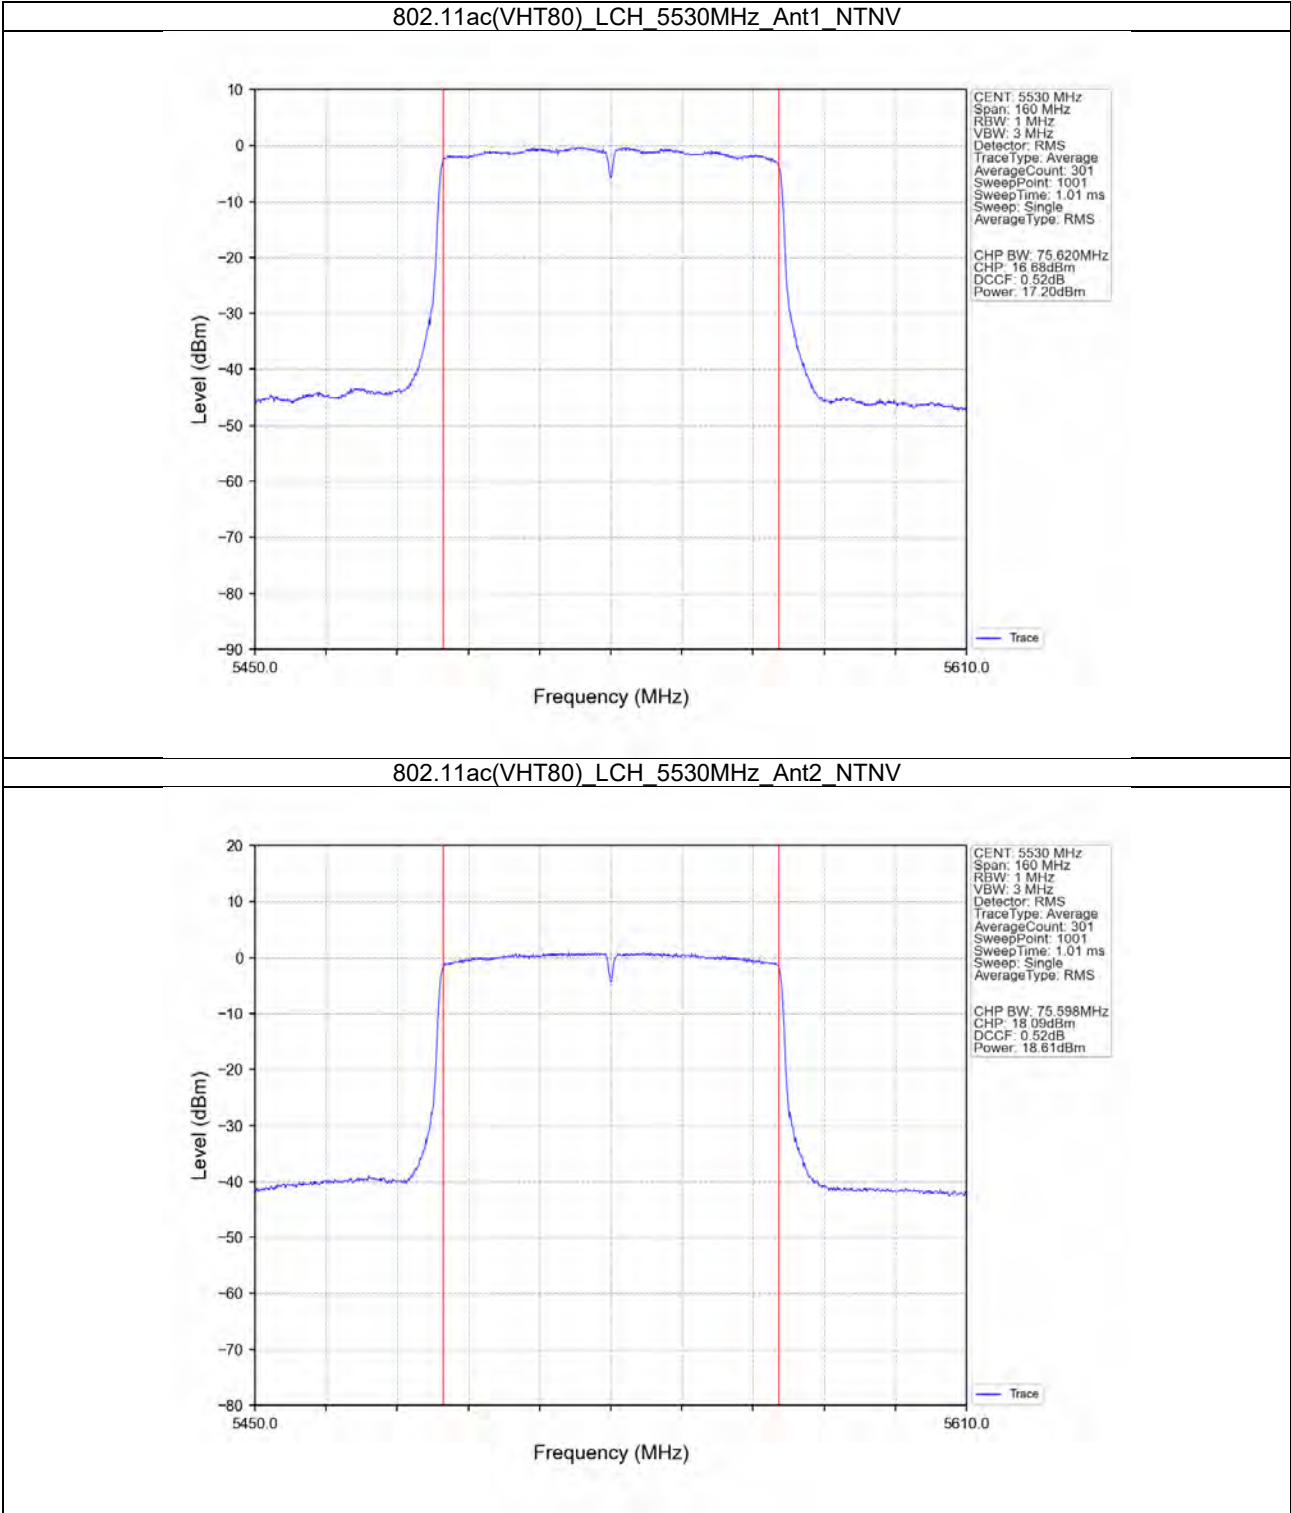



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 293 of 1085

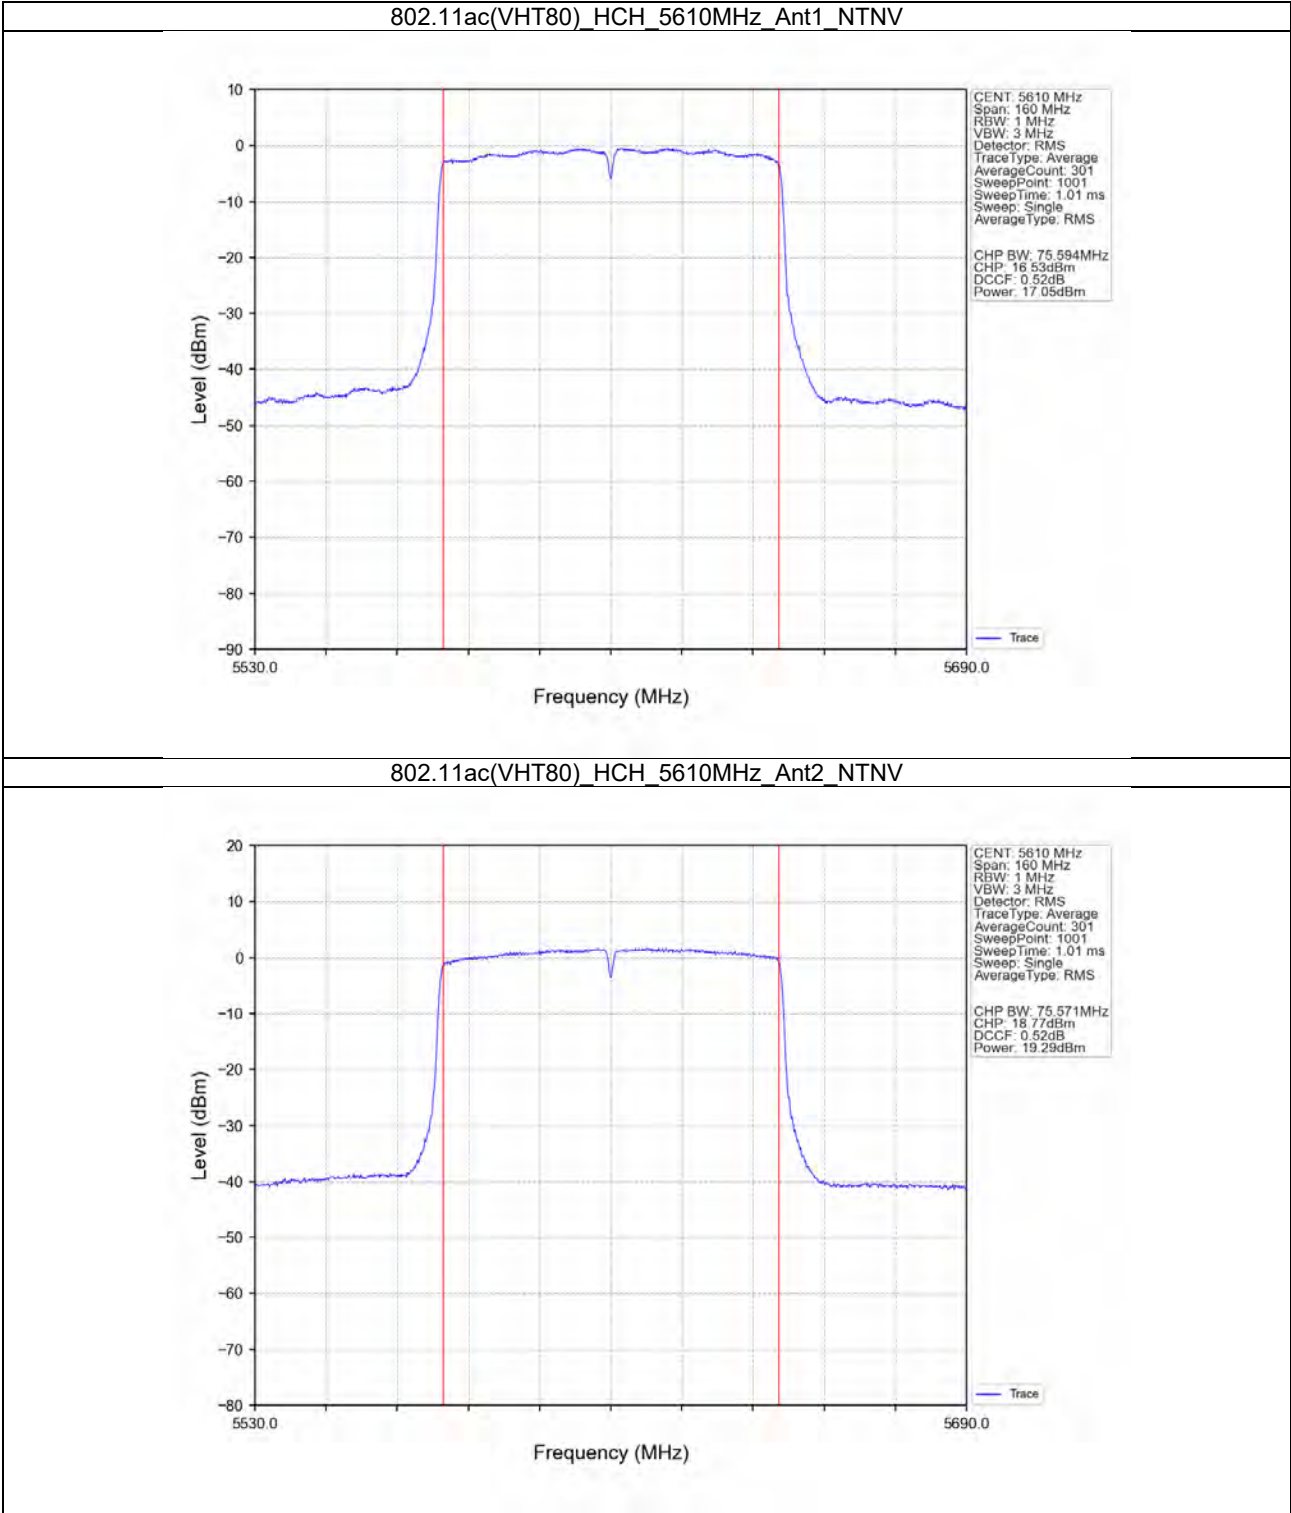



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 294 of 1085

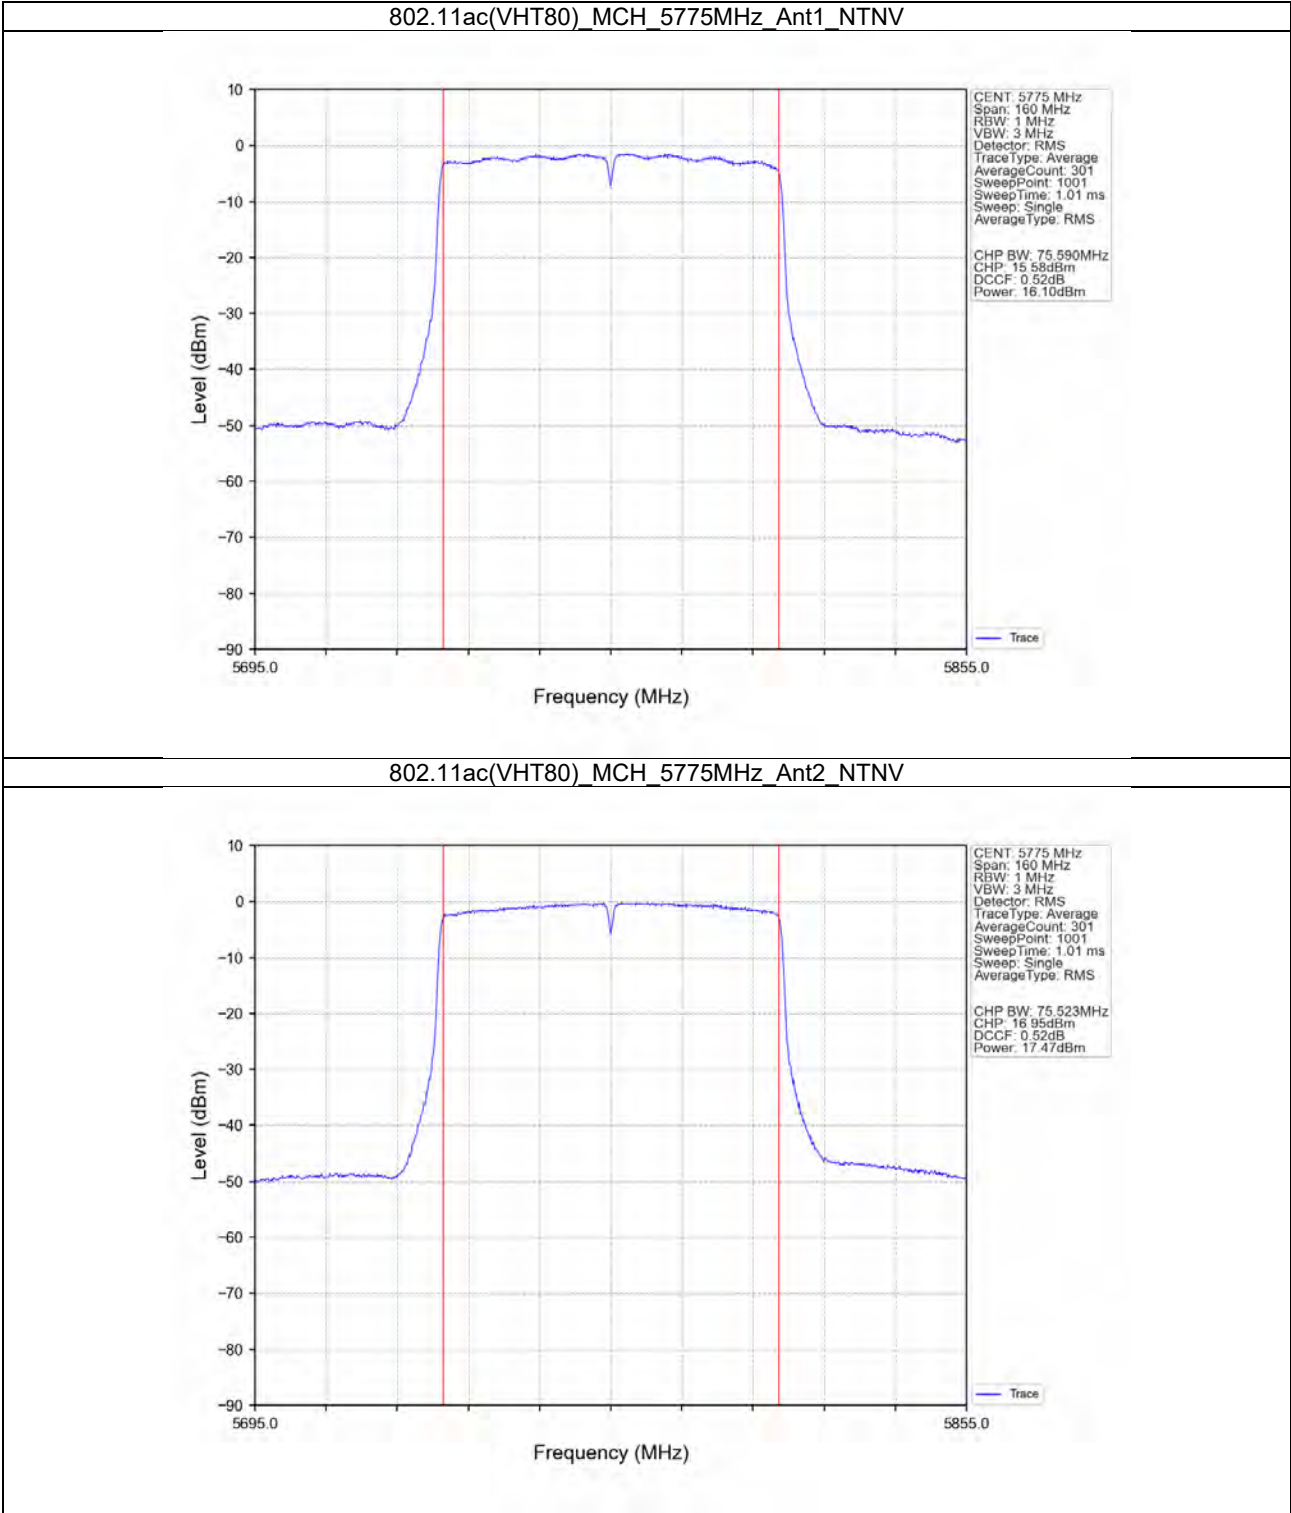



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 295 of 1085

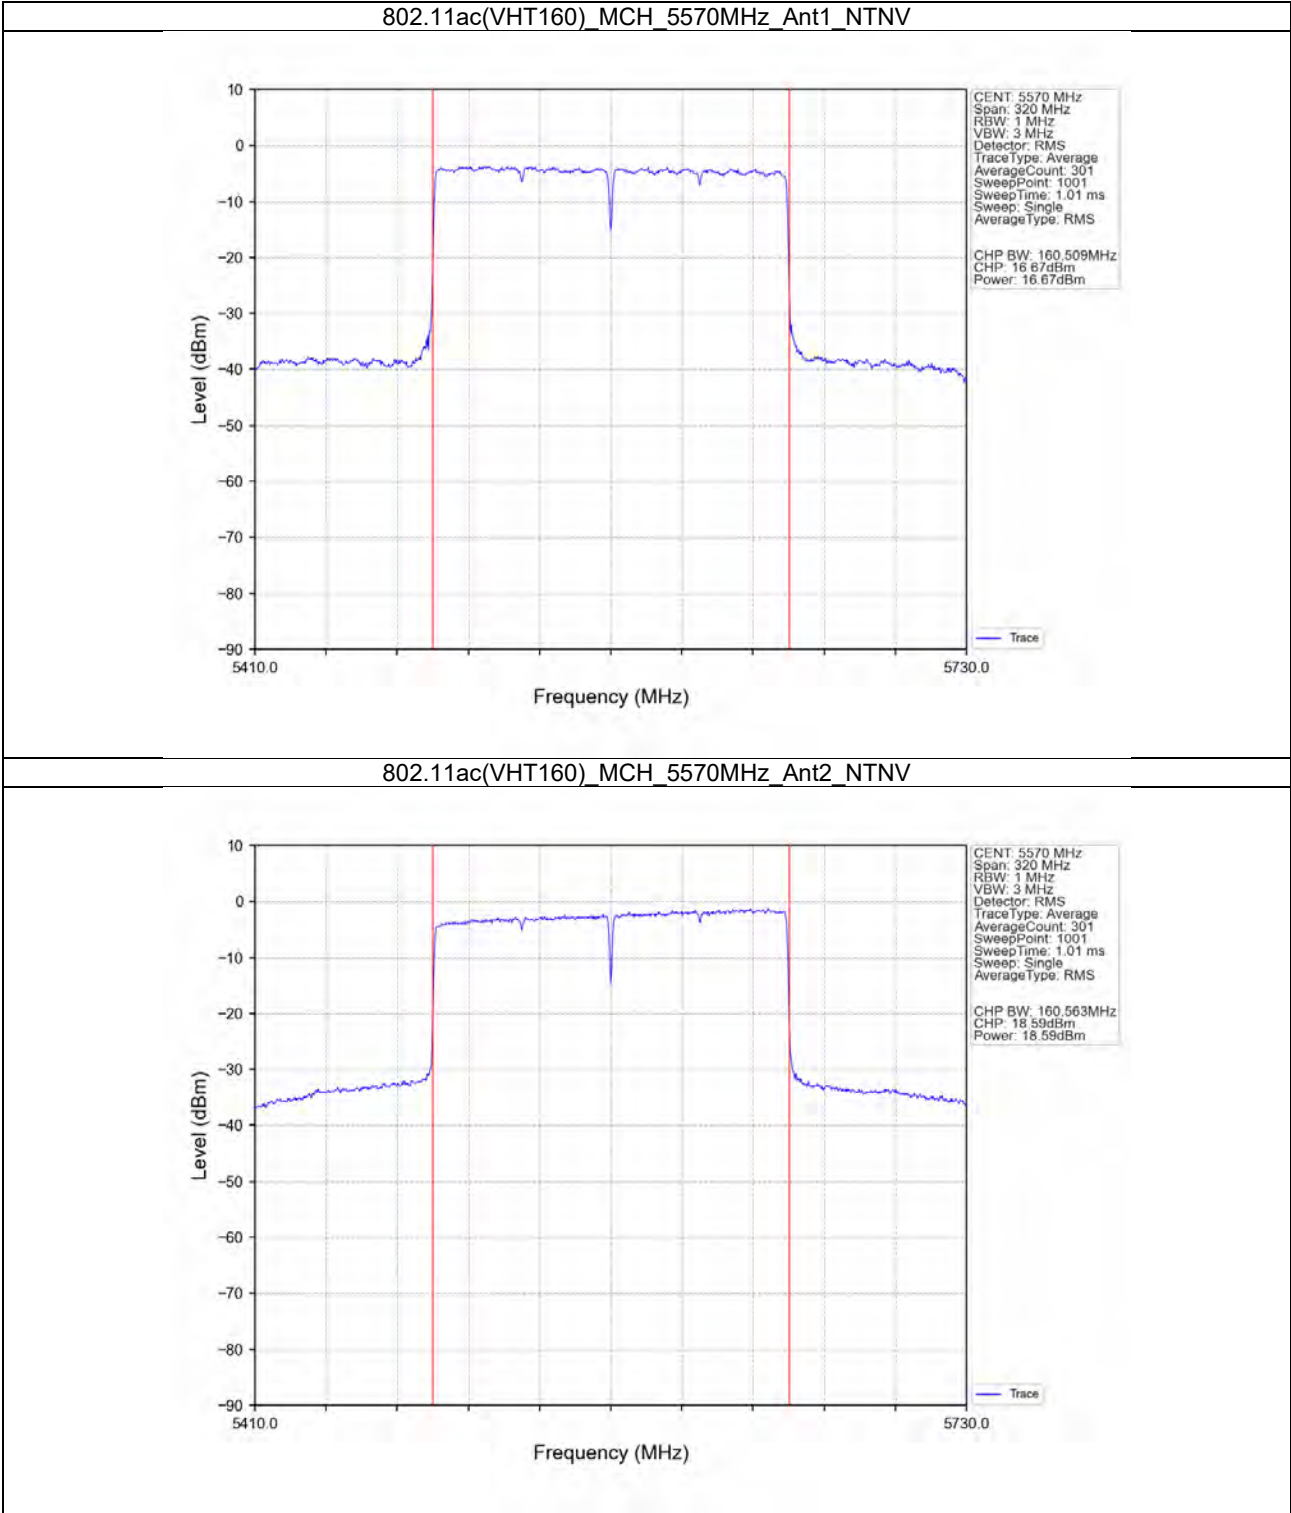



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.

Report No.: SUCR250300017004
Rev.: 01
Page: 296 of 1085

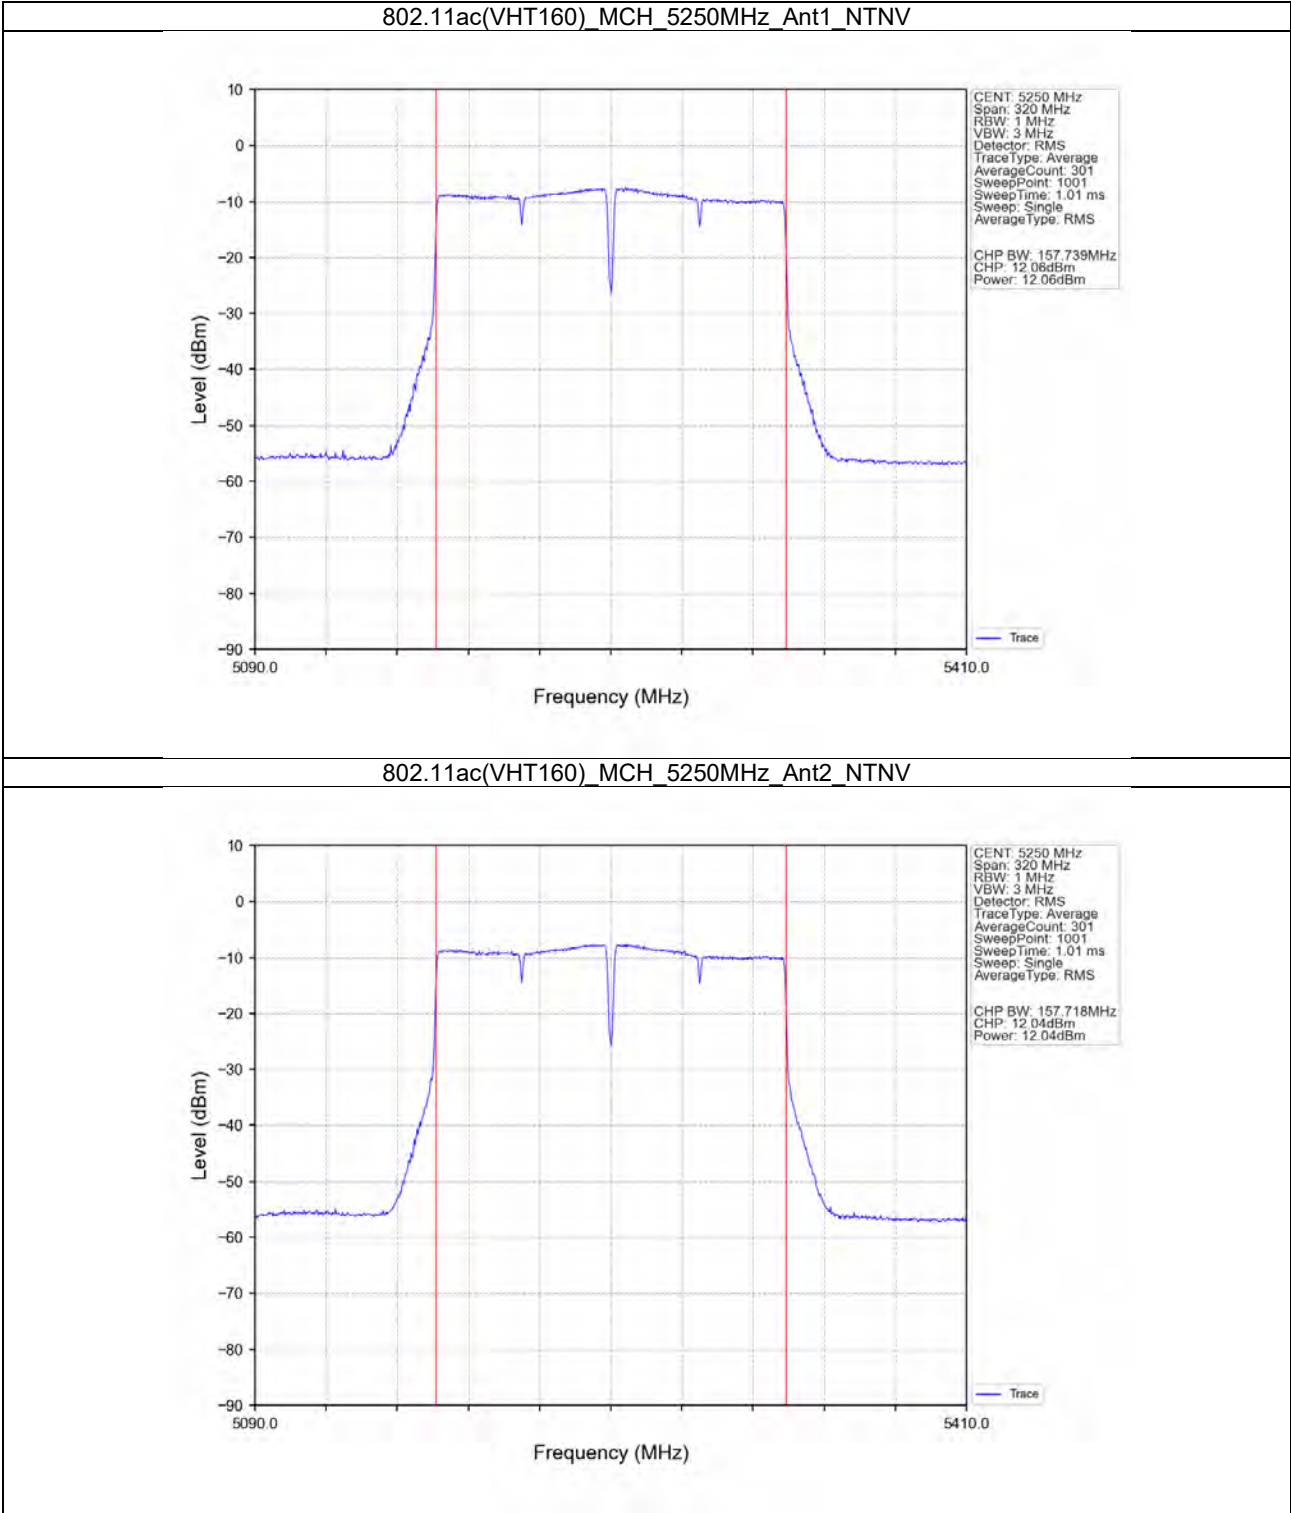





SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.

Report No.: SUCR250300017004
Rev.: 01
Page: 297 of 1085

802.11ax(HEW20)_LCH_5180MHz_SU_/_Ant1_NTNV

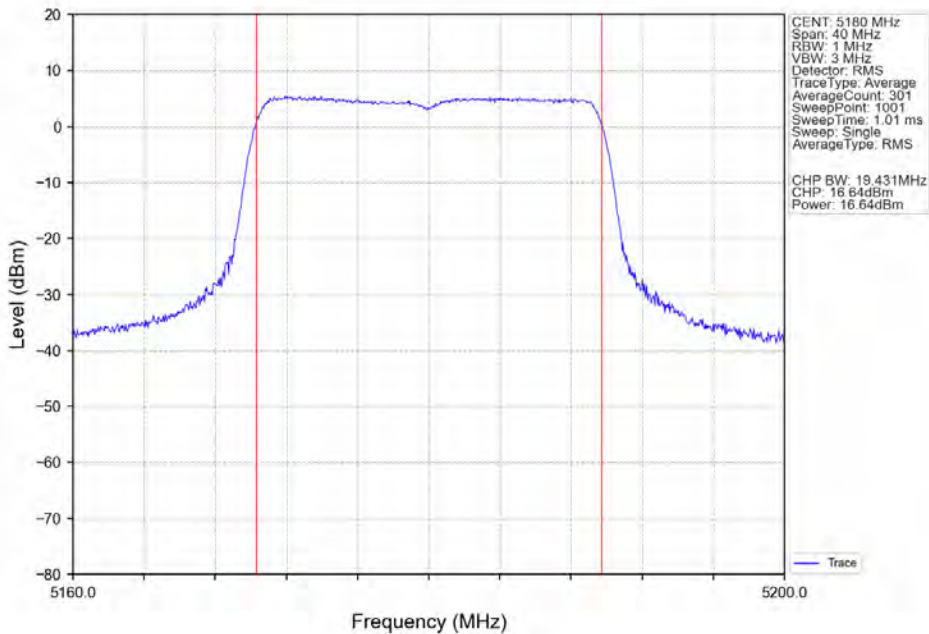

802.11ax(HEW20)_LCH_5180MHz_SU_/_Ant2_NTNV

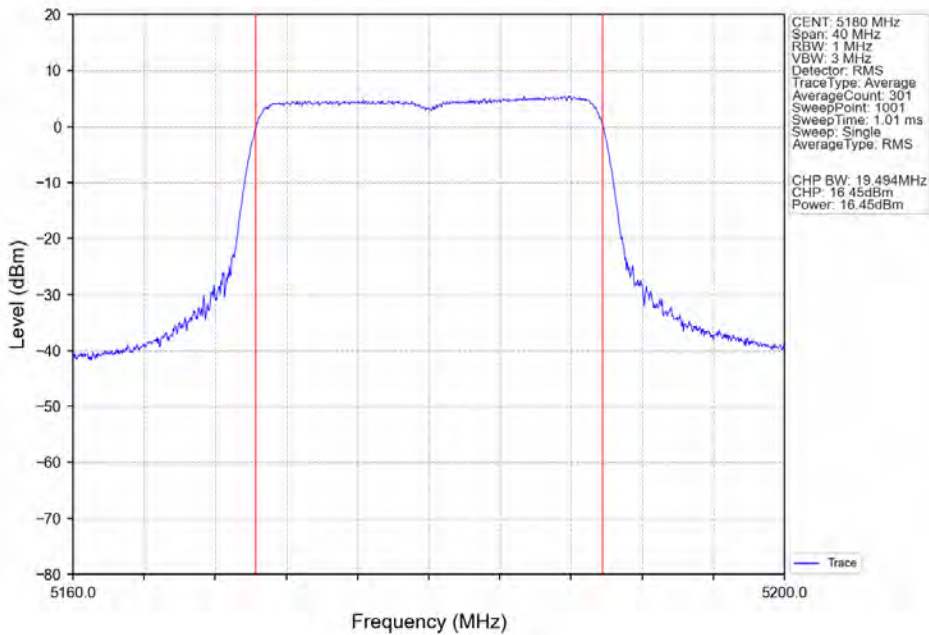





SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.

Report No.: SUCR250300017004
Rev.: 01
Page: 298 of 1085

802.11ax(HEW20)_MCH_5200MHz_SU / _Ant1_NTNV

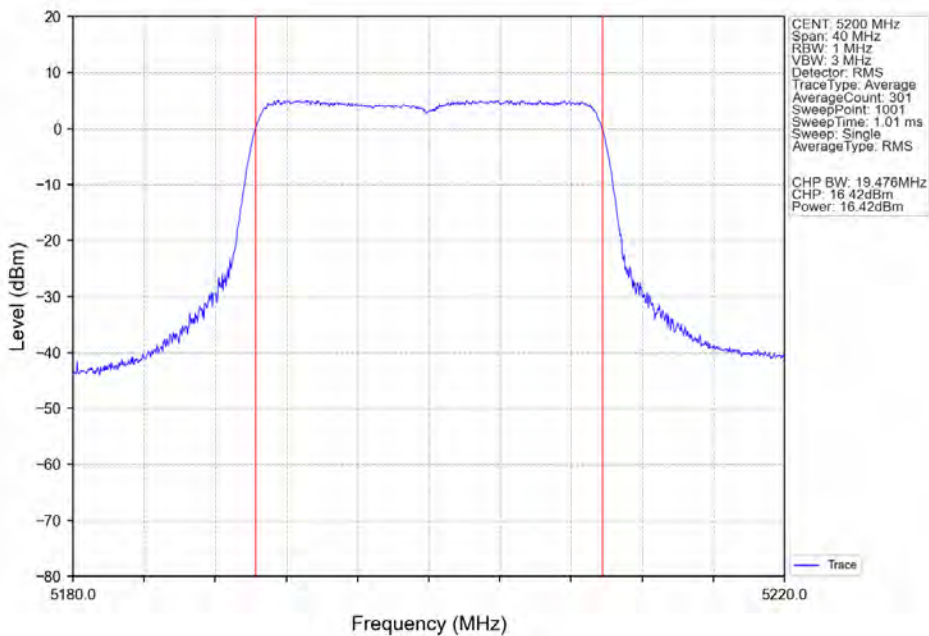

802.11ax(HEW20)_MCH_5200MHz_SU / _Ant2_NTNV

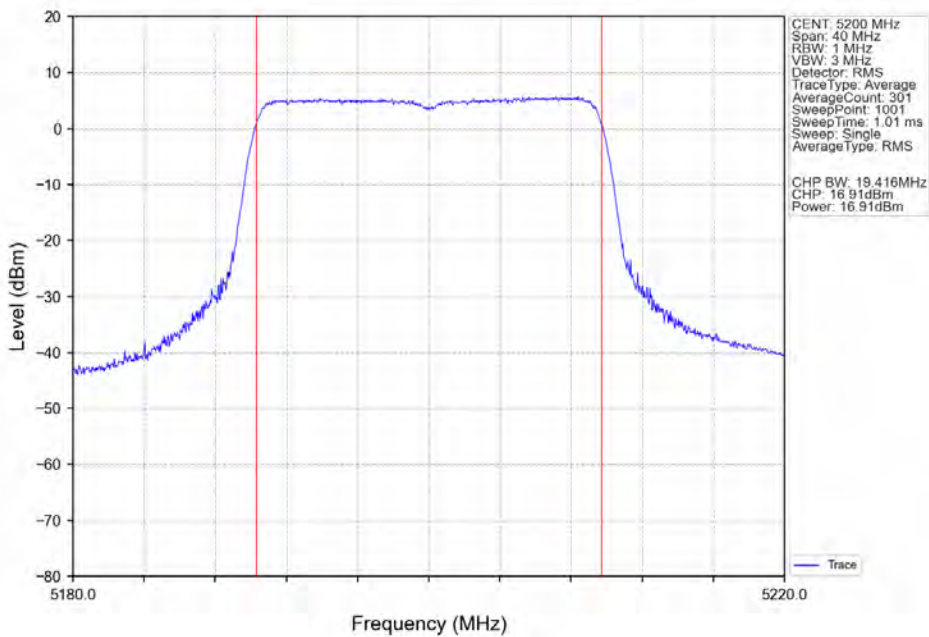





SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.

Report No.: SUCR250300017004
Rev.: 01
Page: 299 of 1085

802.11ax(HEW20)_HCH_5240MHz_SU_/_Ant1_NTNV

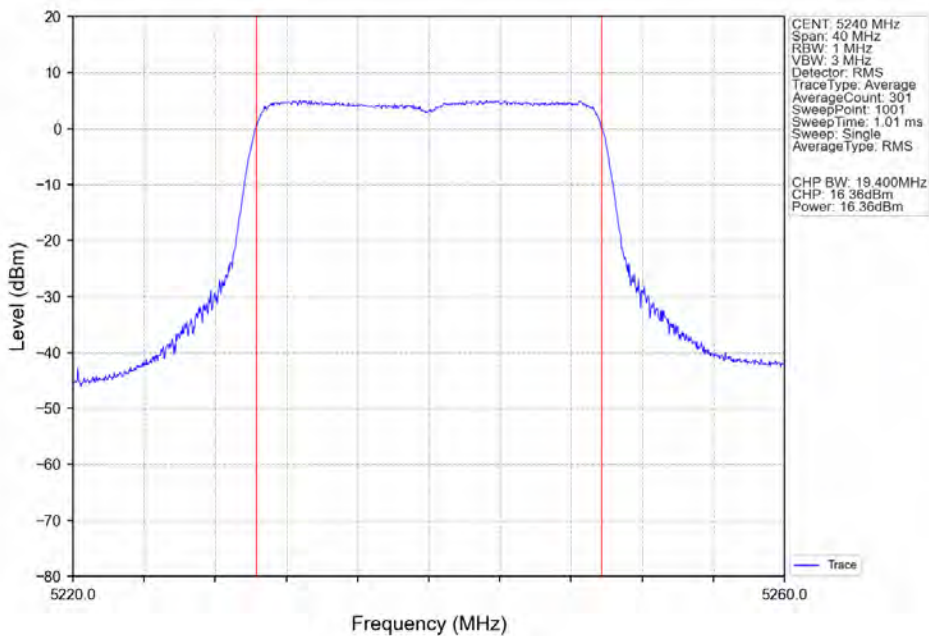


802.11ax(HEW20)_HCH_5240MHz_SU_/_Ant2_NTNV

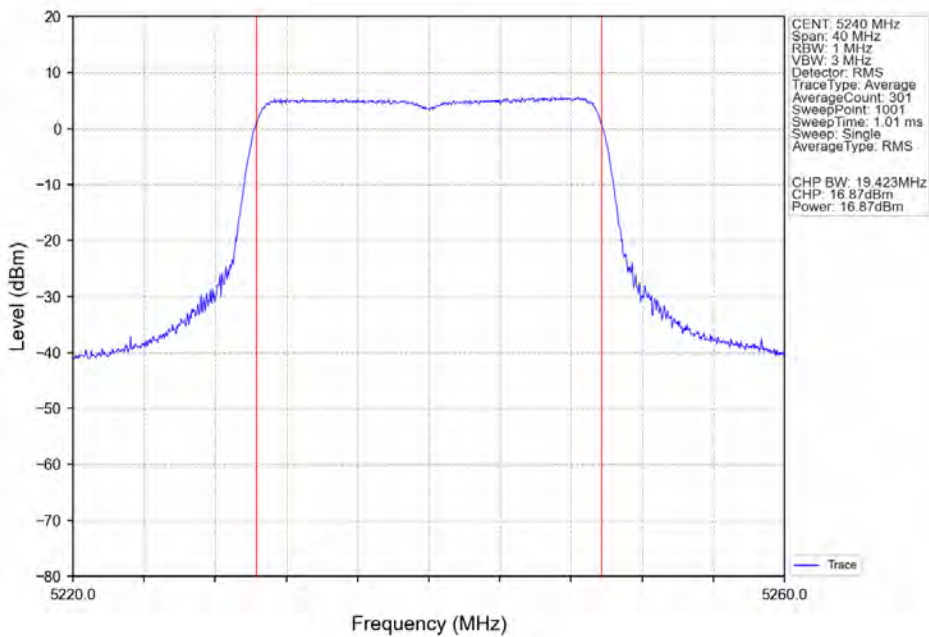



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.

Report No.: SUCR250300017004
Rev.: 01
Page: 300 of 1085

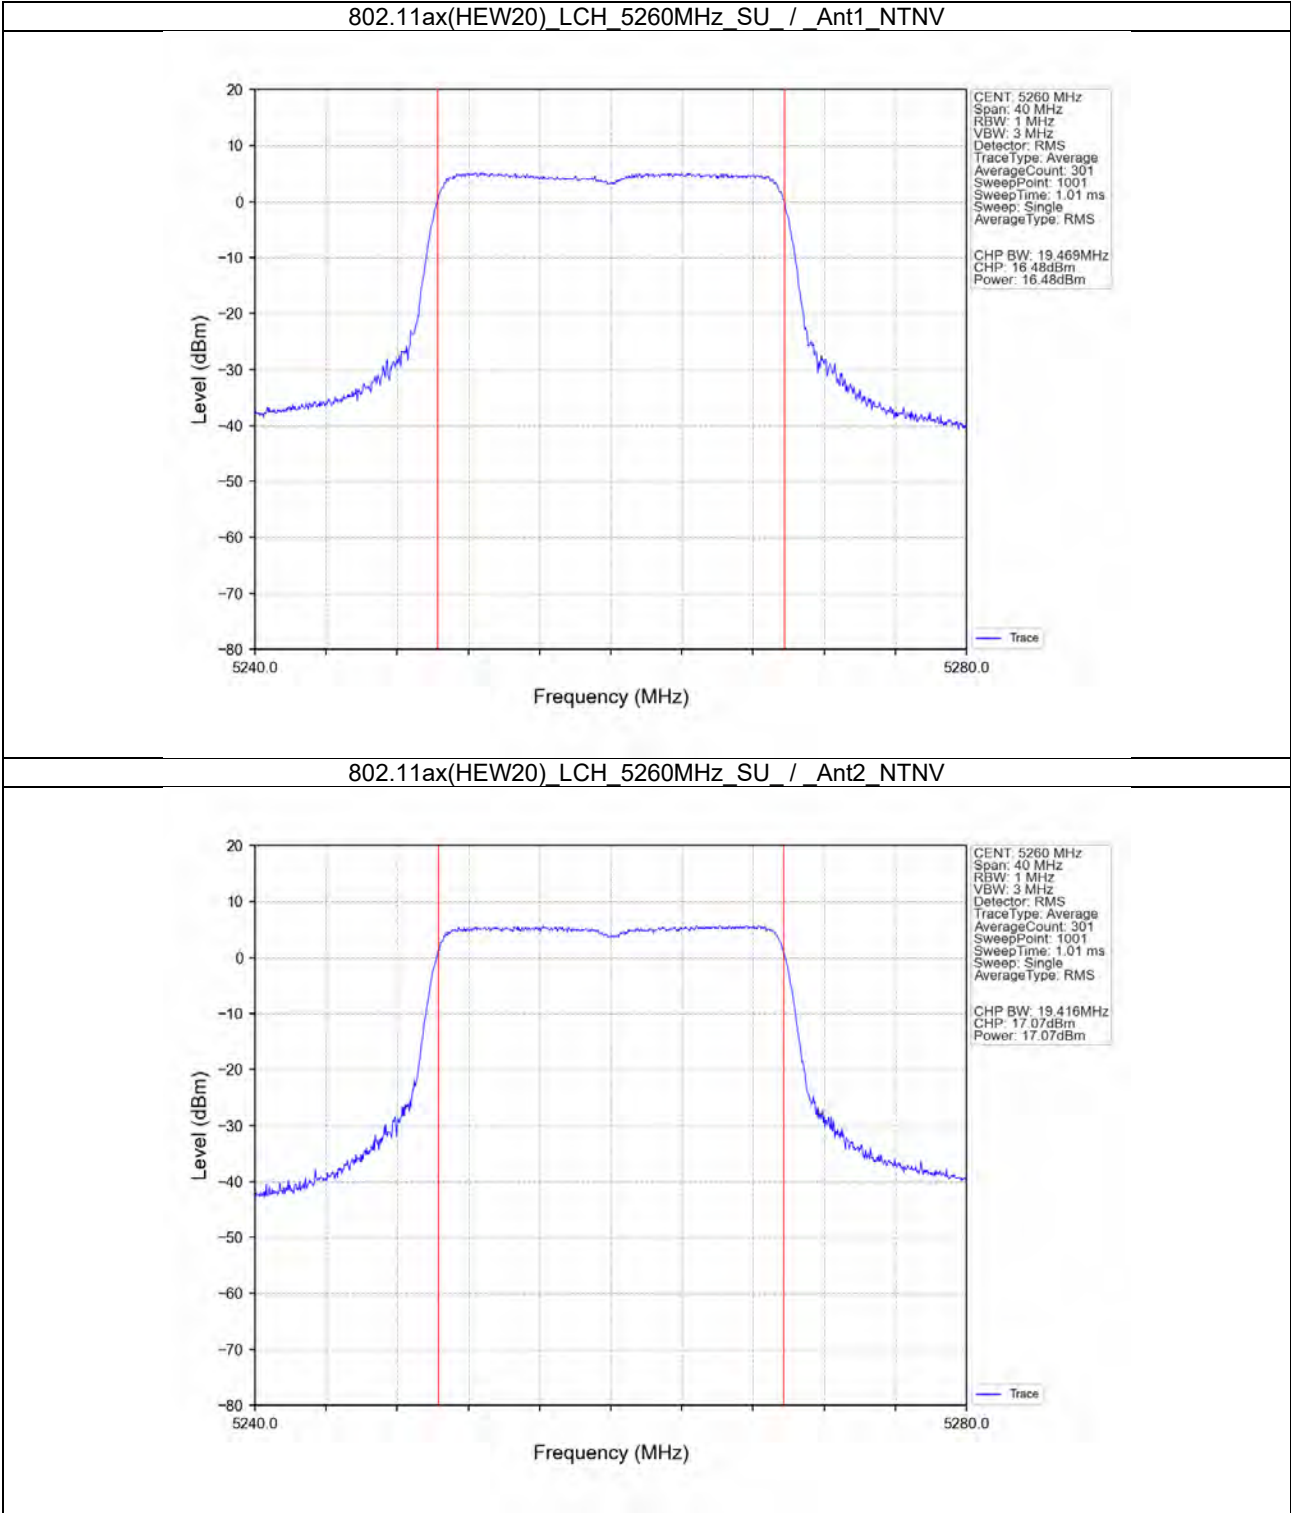





SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.

Report No.: SUCR250300017004
Rev.: 01
Page: 301 of 1085

802.11ax(HEW20)_MCH_5300MHz_SU / _Ant1_NTNV

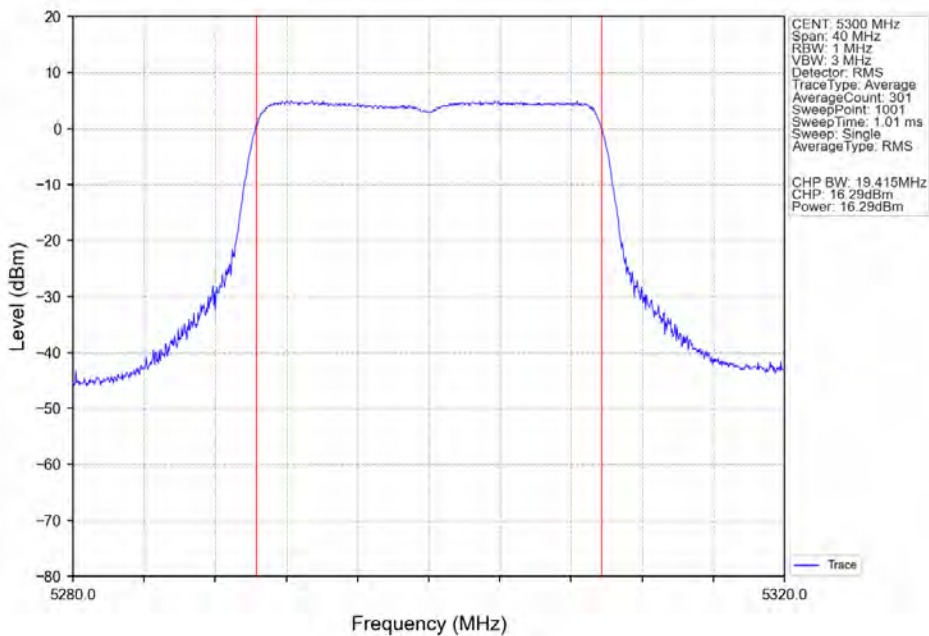


802.11ax(HEW20)_MCH_5300MHz_SU / _Ant2_NTNV

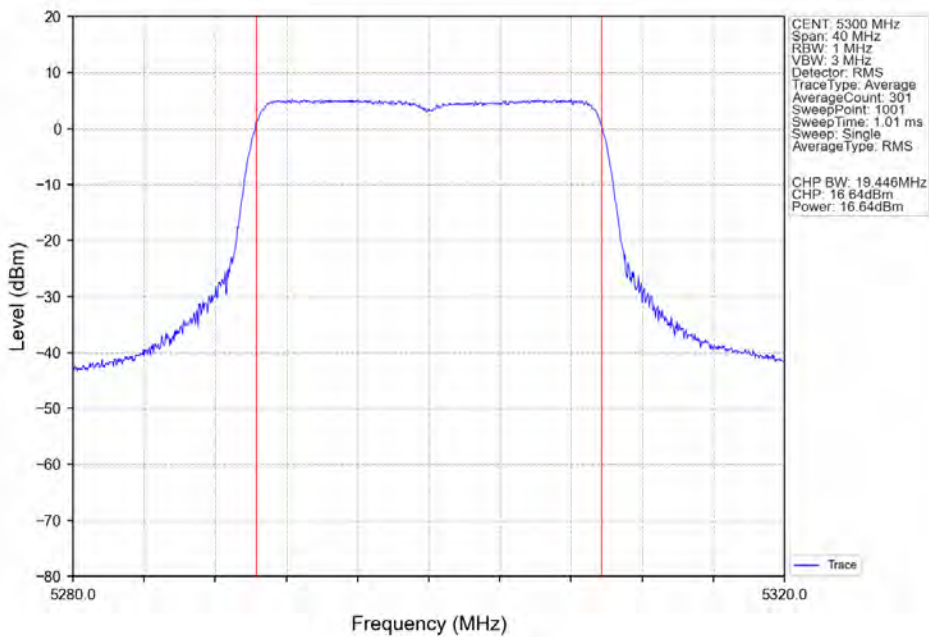



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 302 of 1085

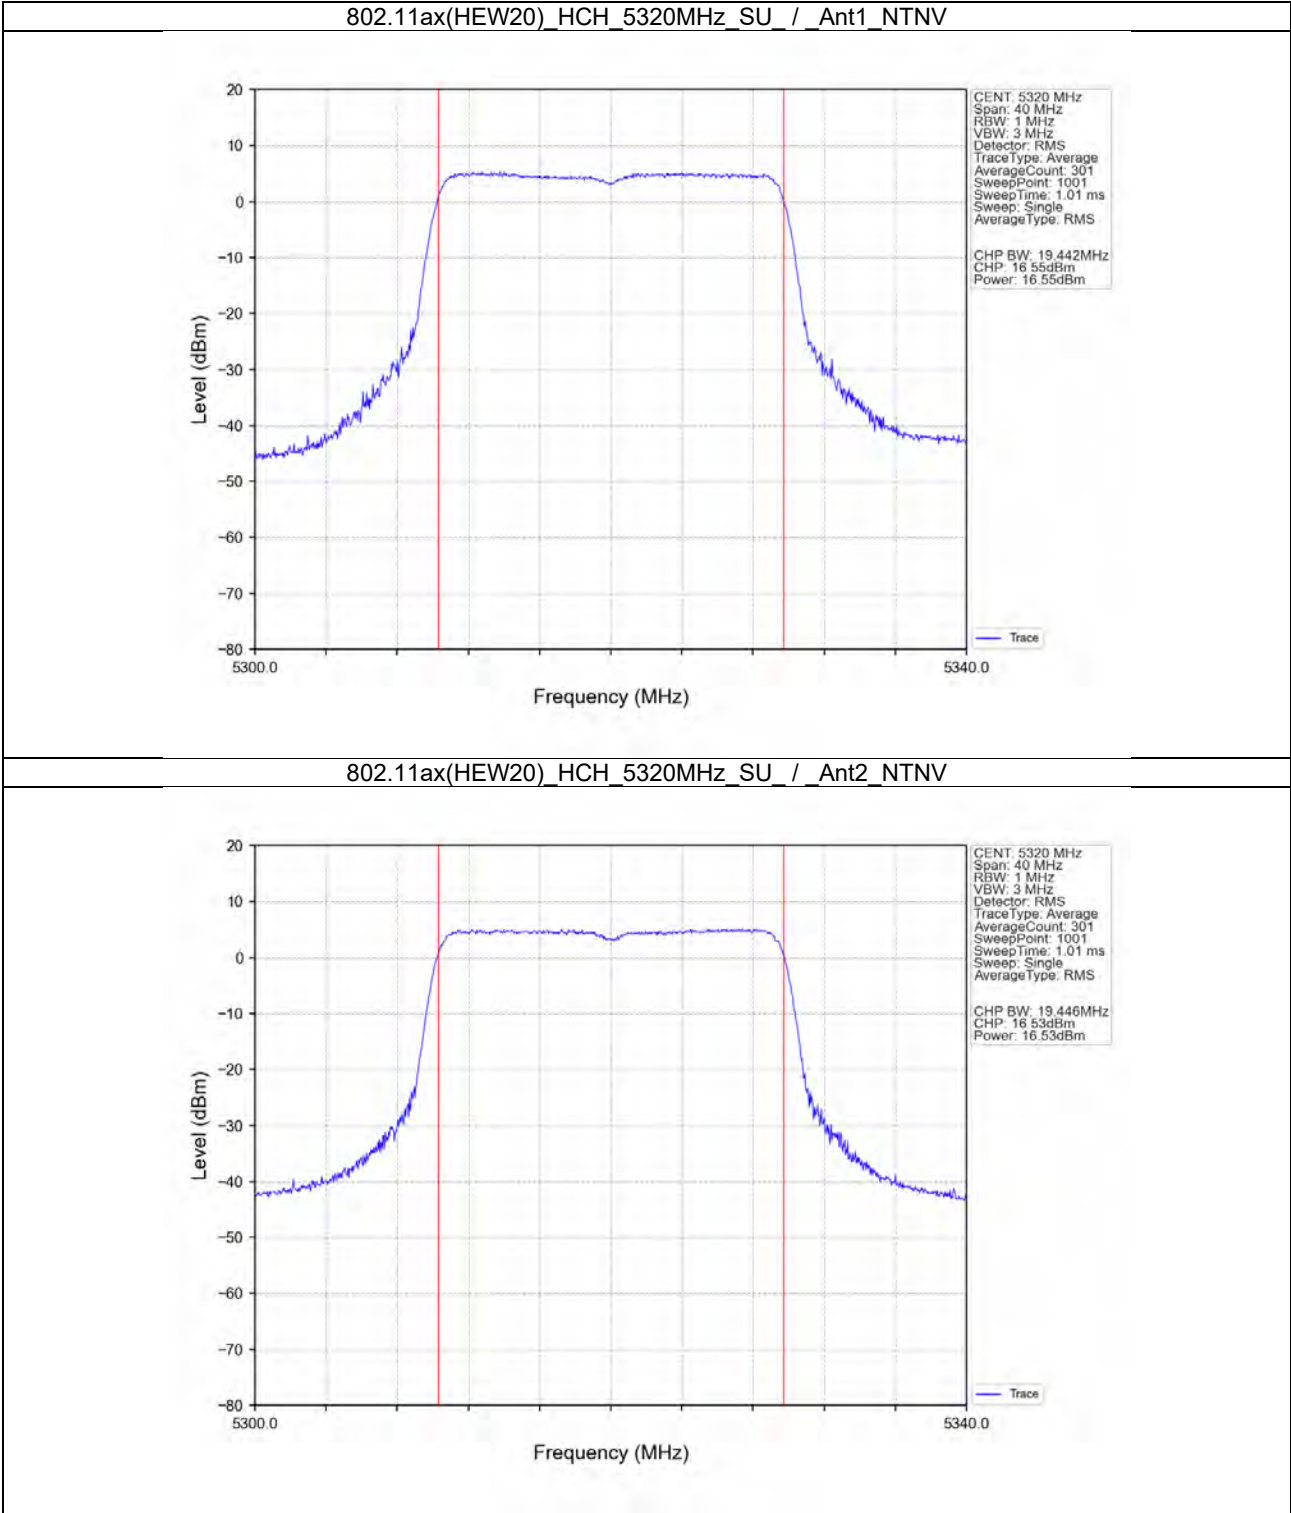



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 303 of 1085

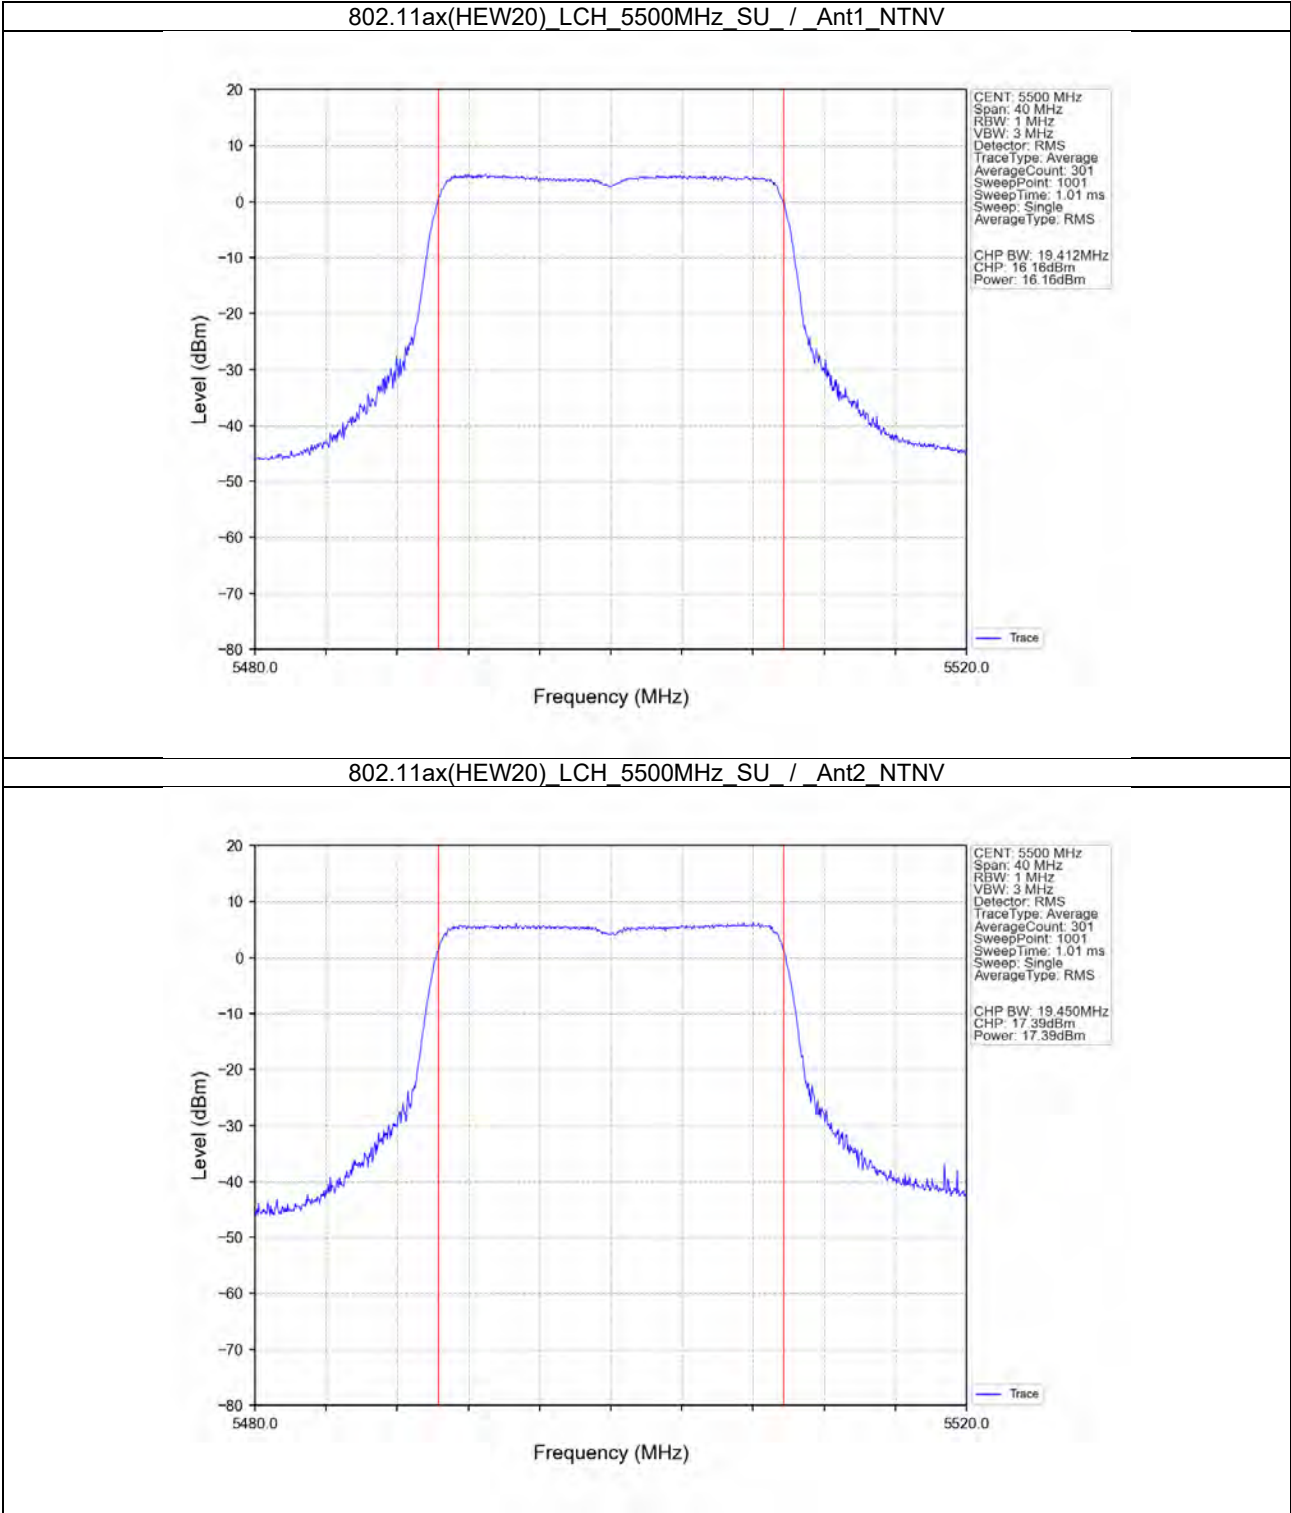



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.

Report No.: SUCR250300017004
Rev.: 01
Page: 304 of 1085

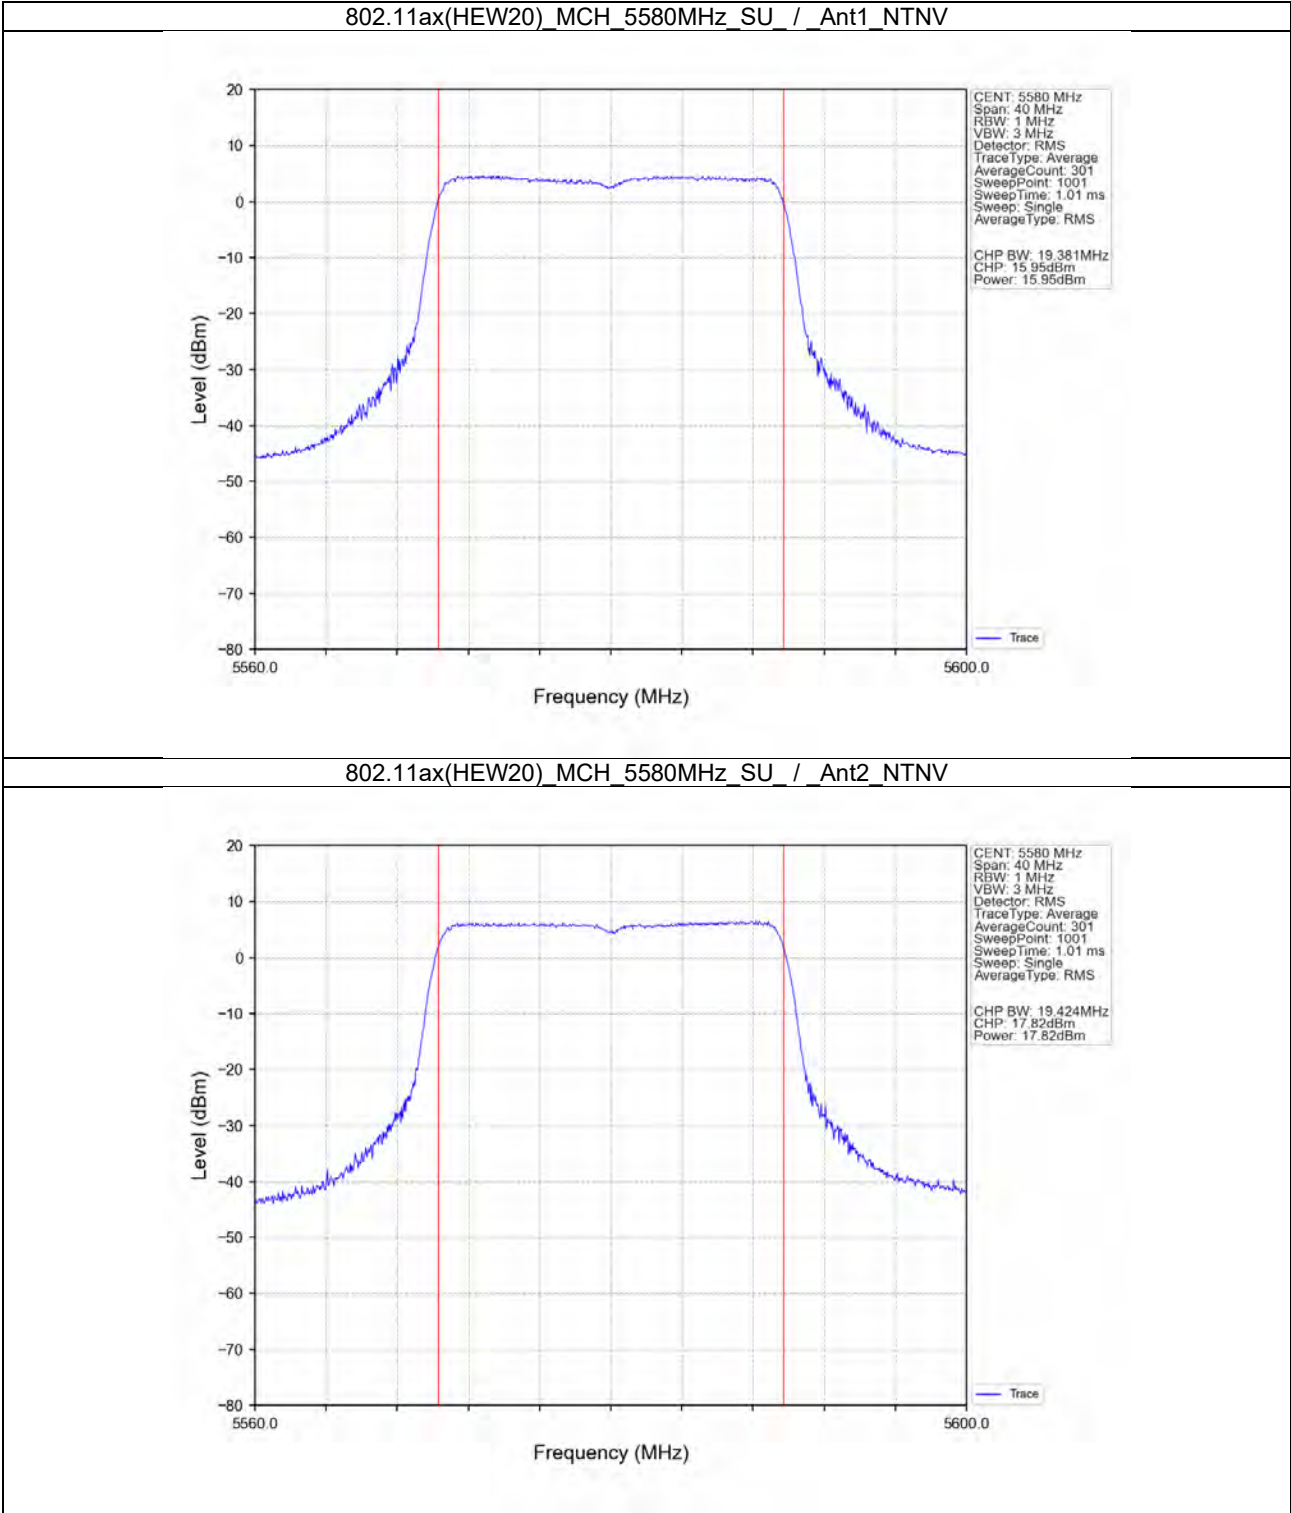





SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.

Report No.: SUCR250300017004
Rev.: 01
Page: 305 of 1085

802.11ax(HEW20)_HCH_5700MHz_SU / _Ant1_NTNV

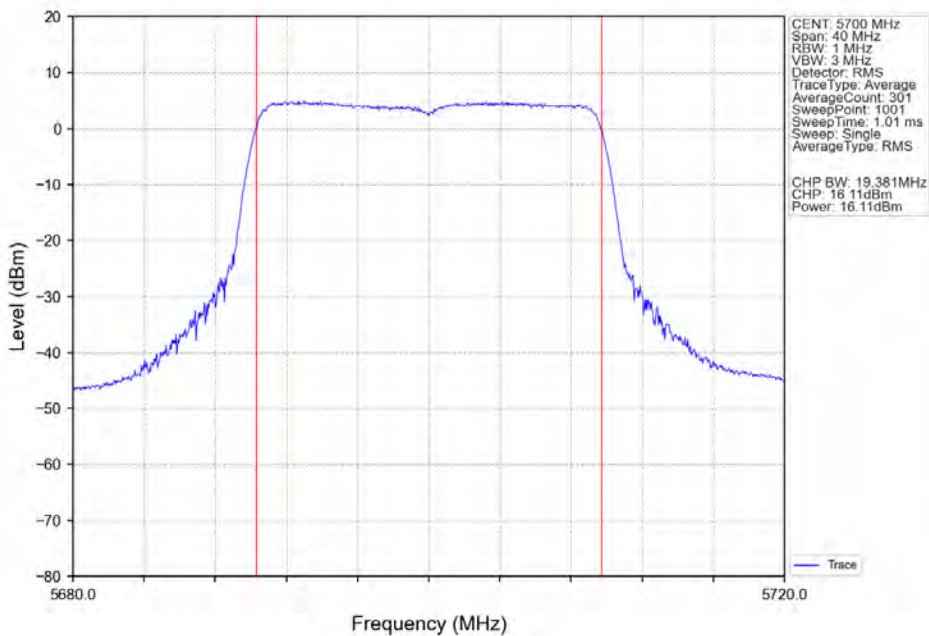

802.11ax(HEW20)_HCH_5700MHz_SU / _Ant2_NTNV

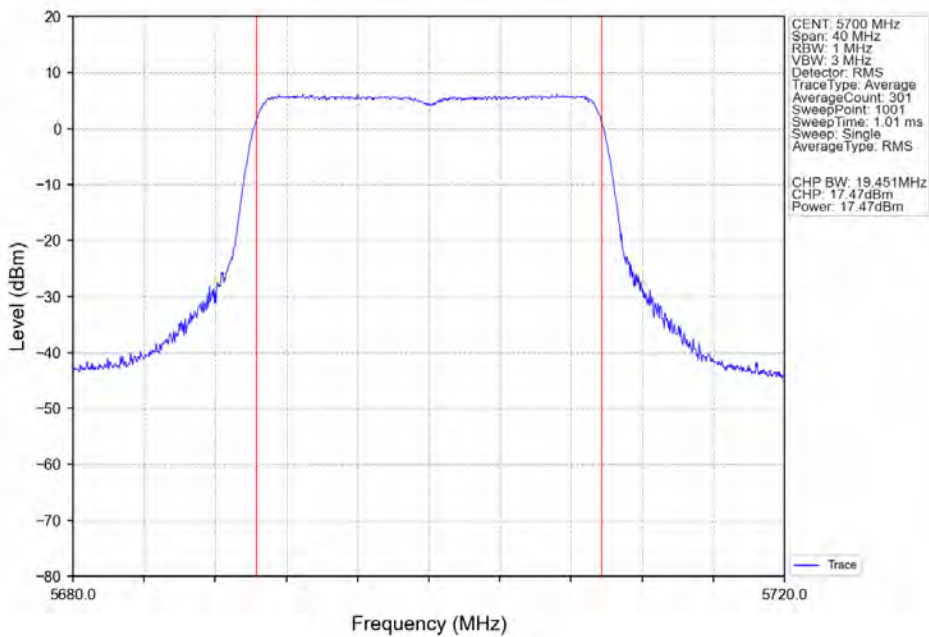





SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.

Report No.: SUCR250300017004
Rev.: 01
Page: 306 of 1085

802.11ax(HEW20)_LCH_5745MHz_SU_/_Ant1_NTNV

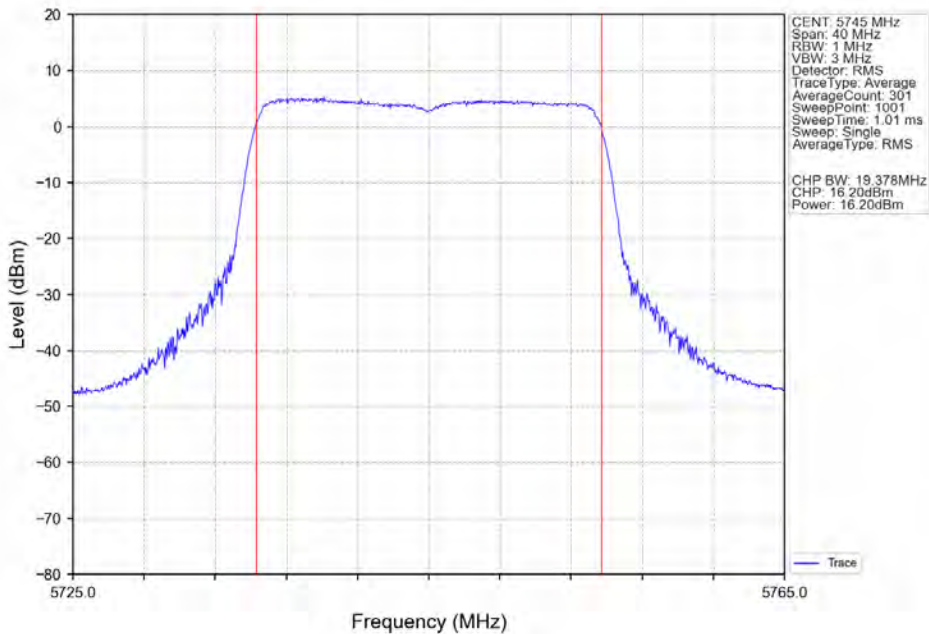

802.11ax(HEW20)_LCH_5745MHz_SU_/_Ant2_NTNV

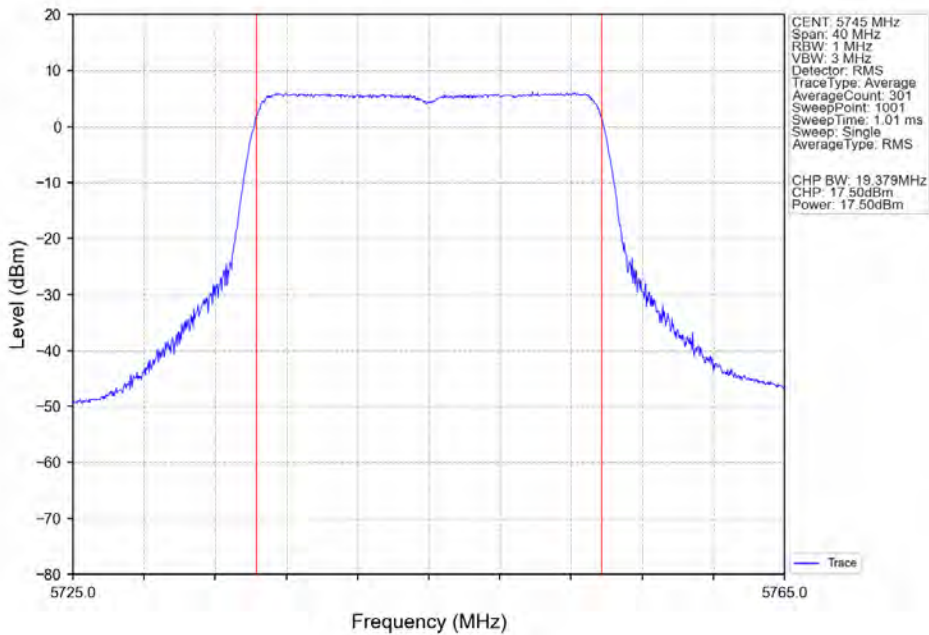





SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.

Report No.: SUCR250300017004
Rev.: 01
Page: 307 of 1085

802.11ax(HEW20)_MCH_5785MHz_SU / _Ant1_NTNV

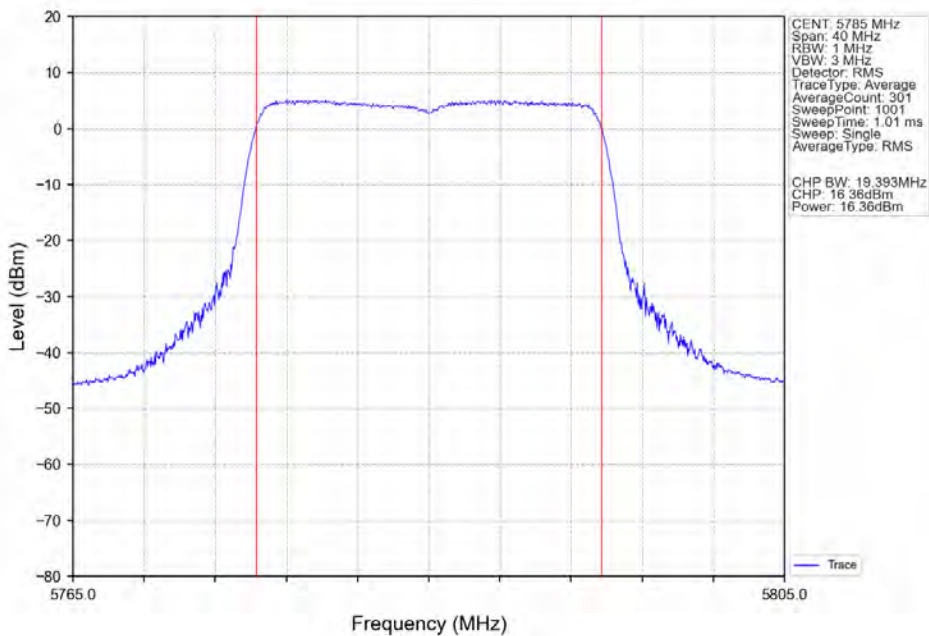


802.11ax(HEW20)_MCH_5785MHz_SU / _Ant2_NTNV

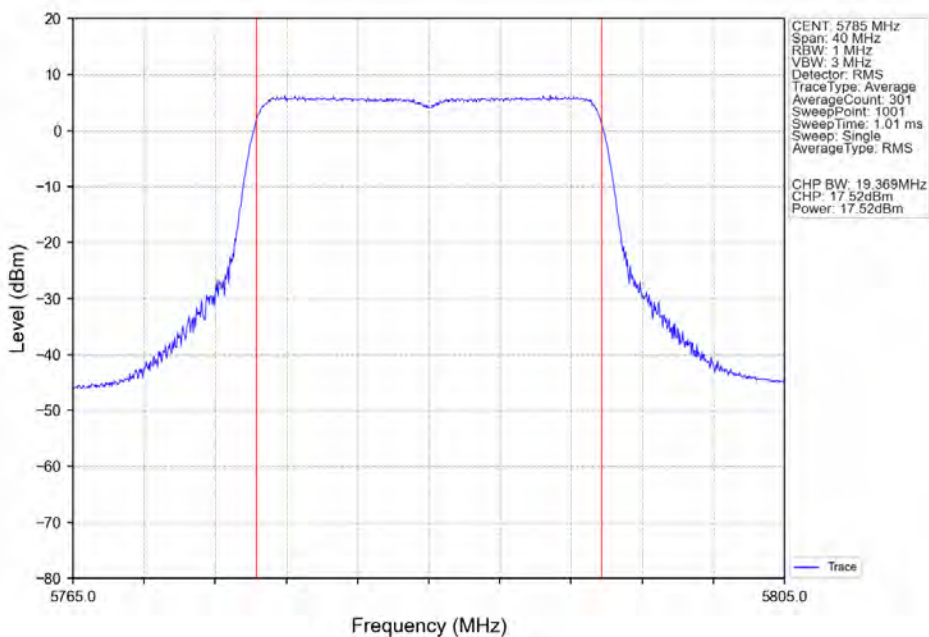



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 308 of 1085

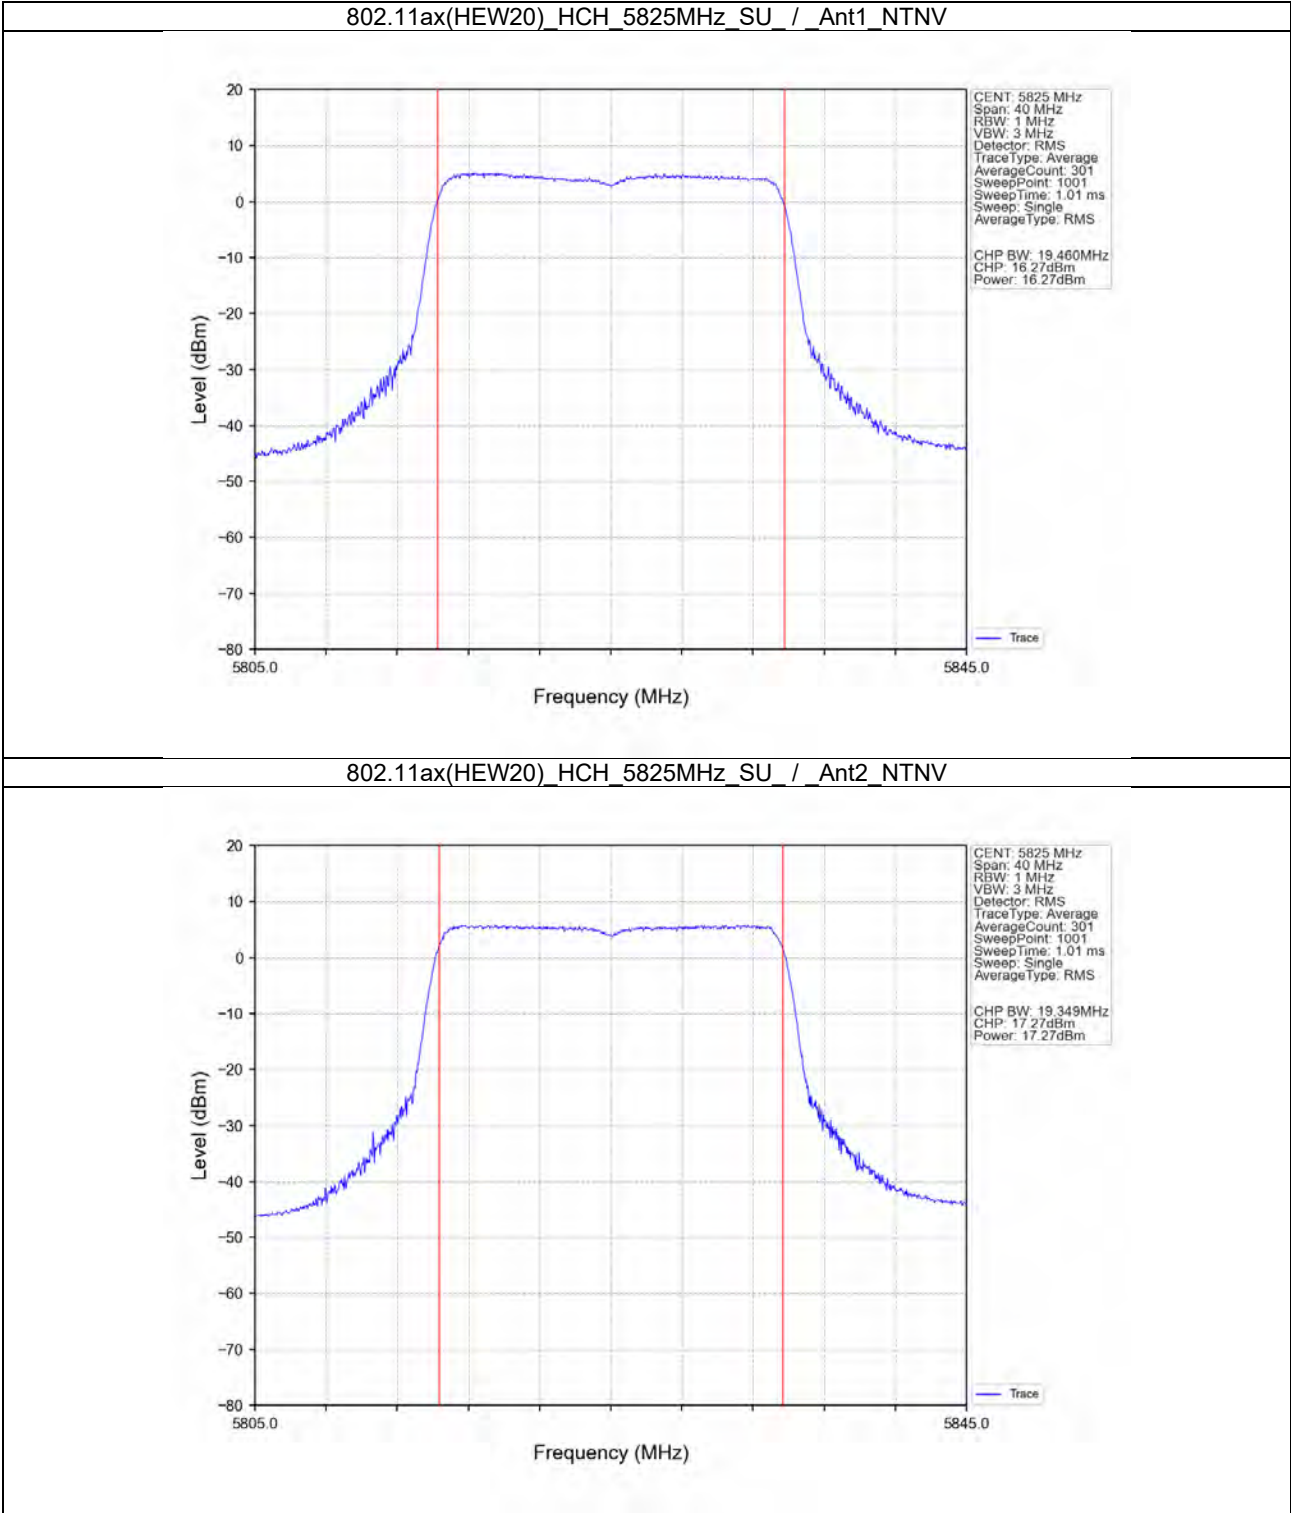



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 309 of 1085

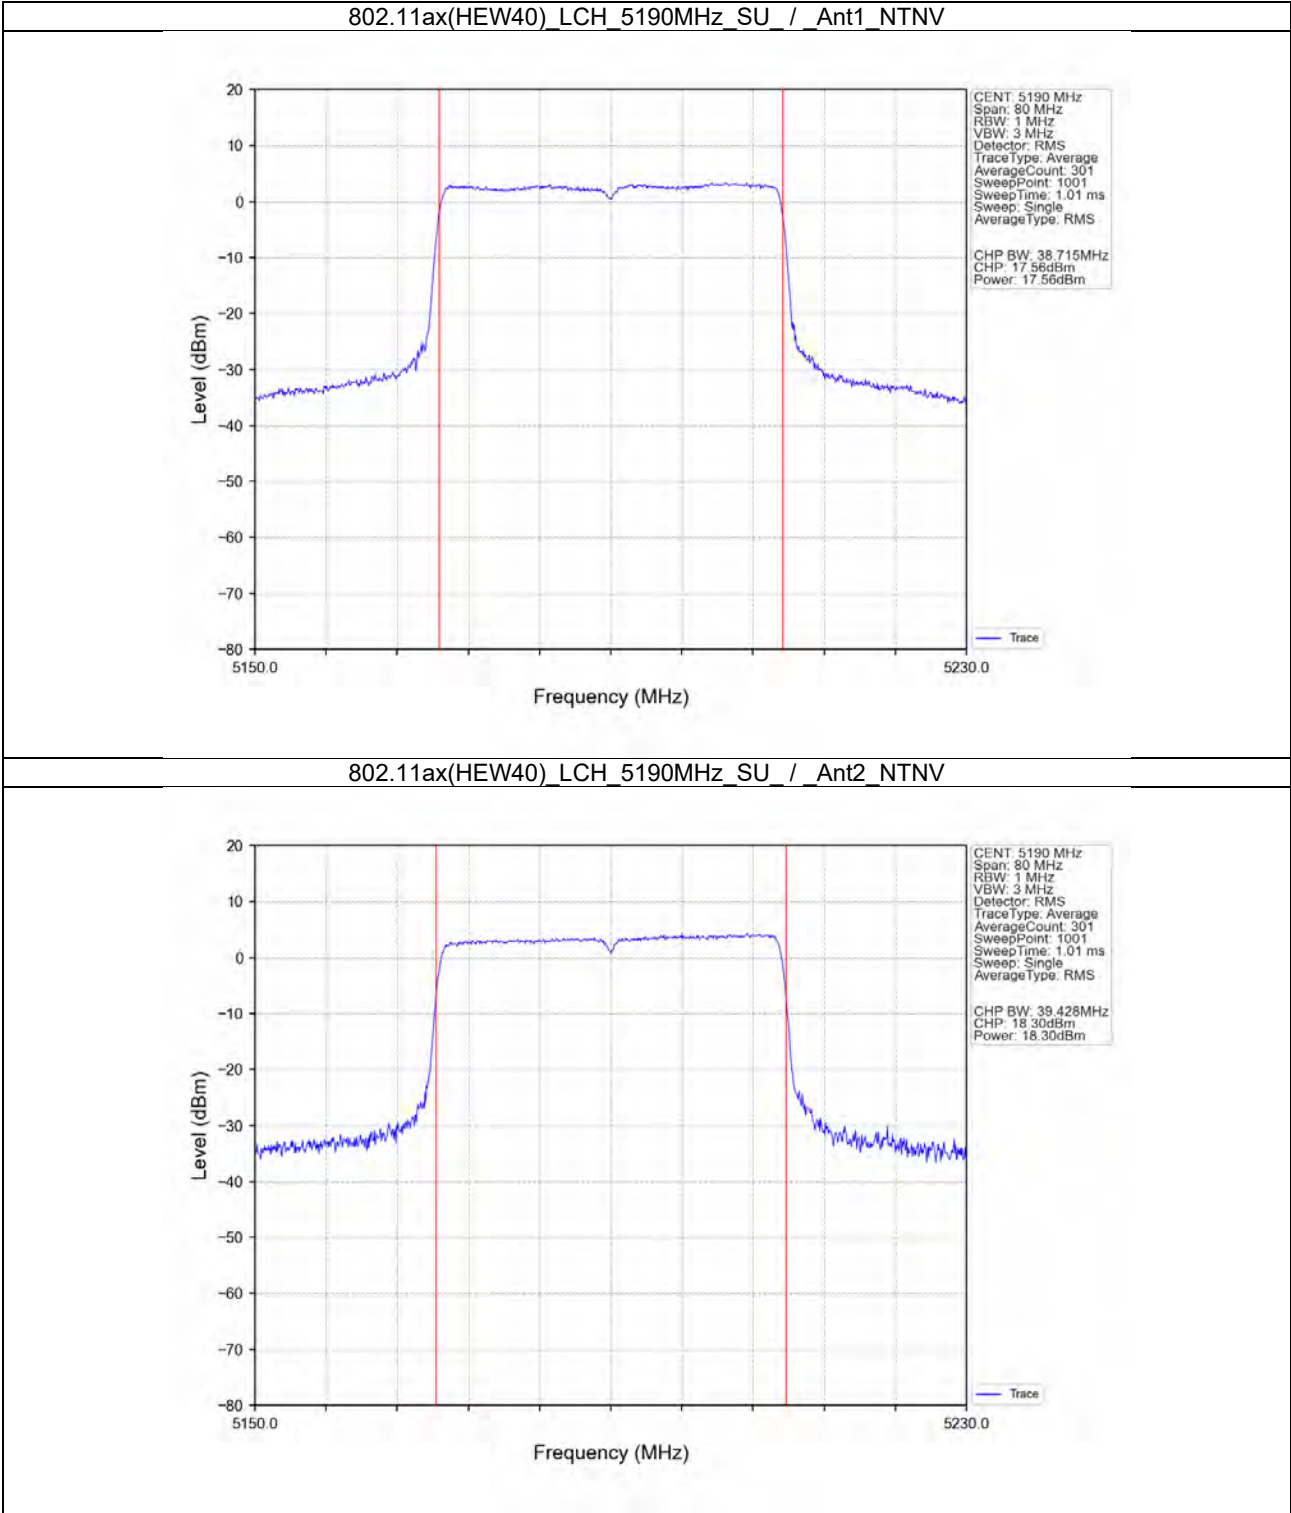



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.

Report No.: SUCR250300017004
Rev.: 01
Page: 310 of 1085

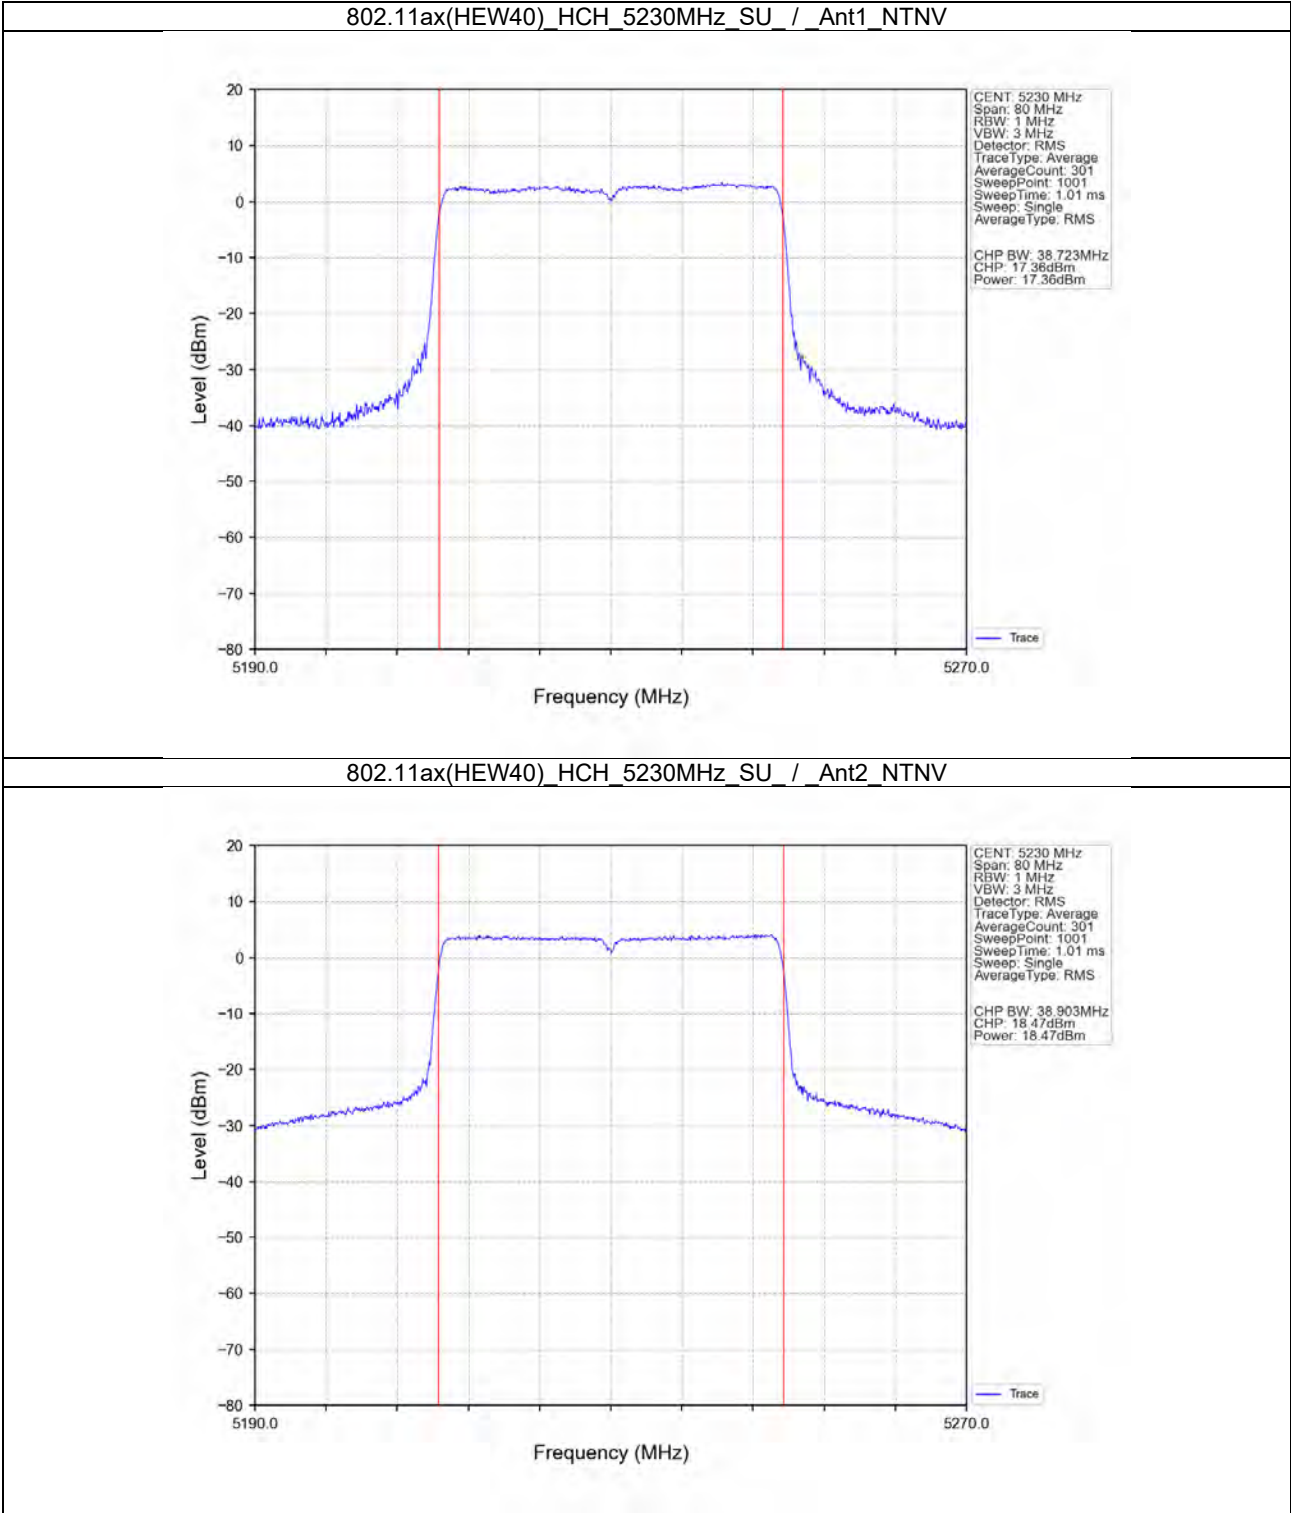





SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.

Report No.: SUCR250300017004
Rev.: 01
Page: 311 of 1085

802.11ax(HEW40)_LCH_5270MHz_SU_/_Ant1_NTNV

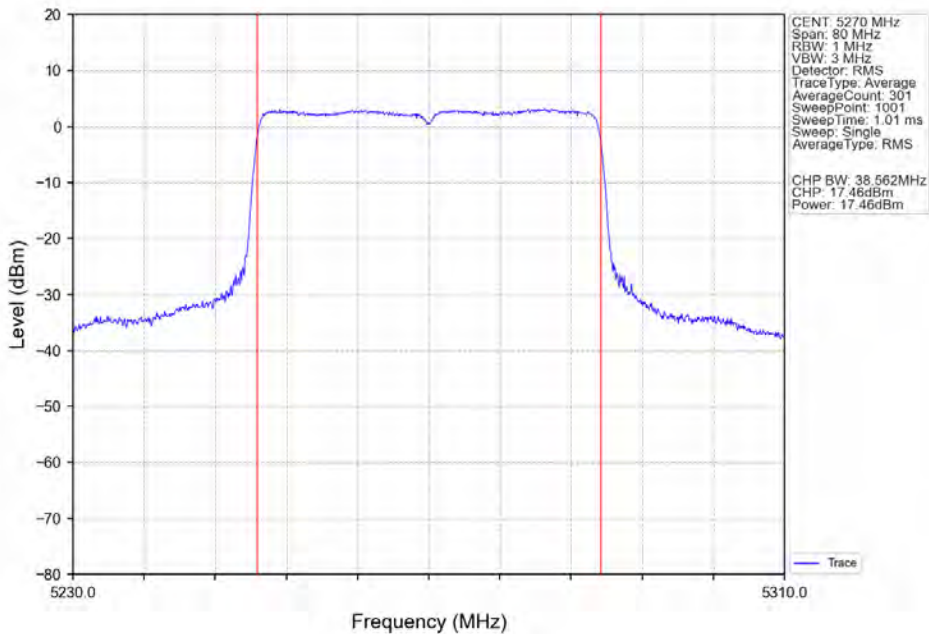

802.11ax(HEW40)_LCH_5270MHz_SU_/_Ant2_NTNV

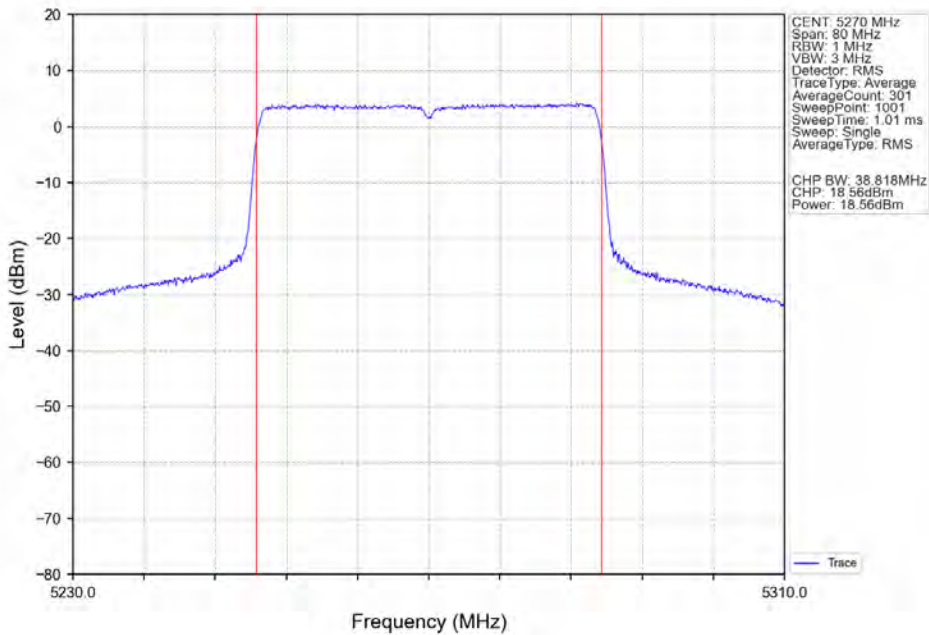





SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.

Report No.: SUCR250300017004
Rev.: 01
Page: 312 of 1085

802.11ax(HEW40)_HCH_5310MHz_SU_/_Ant1_NTNV

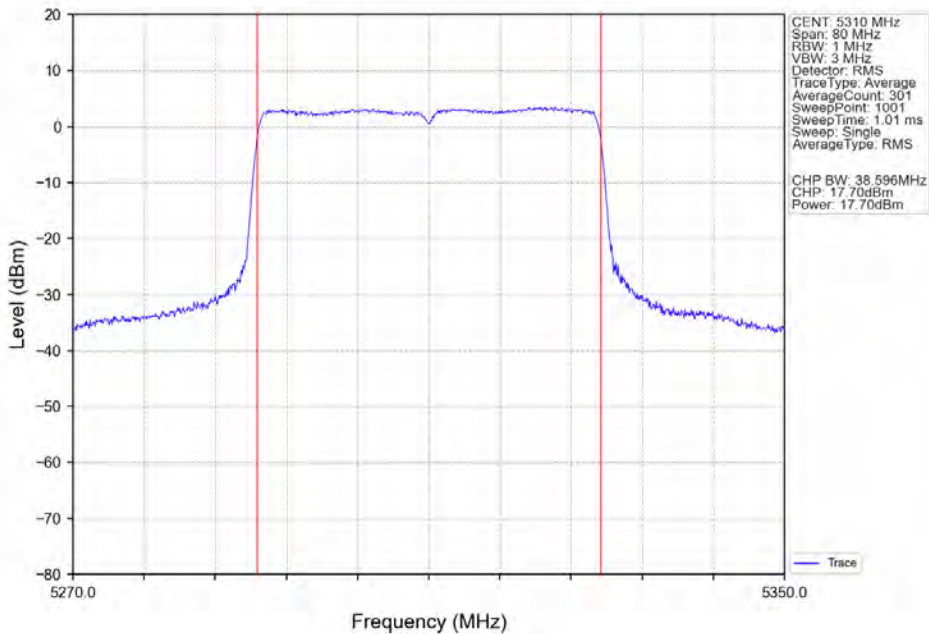


802.11ax(HEW40)_HCH_5310MHz_SU_/_Ant2_NTNV

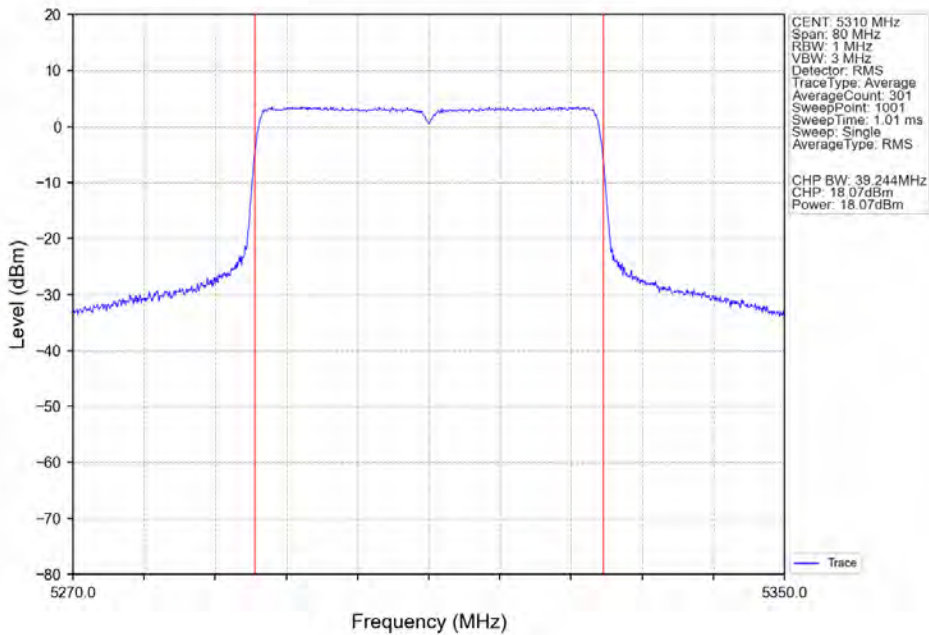



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 313 of 1085

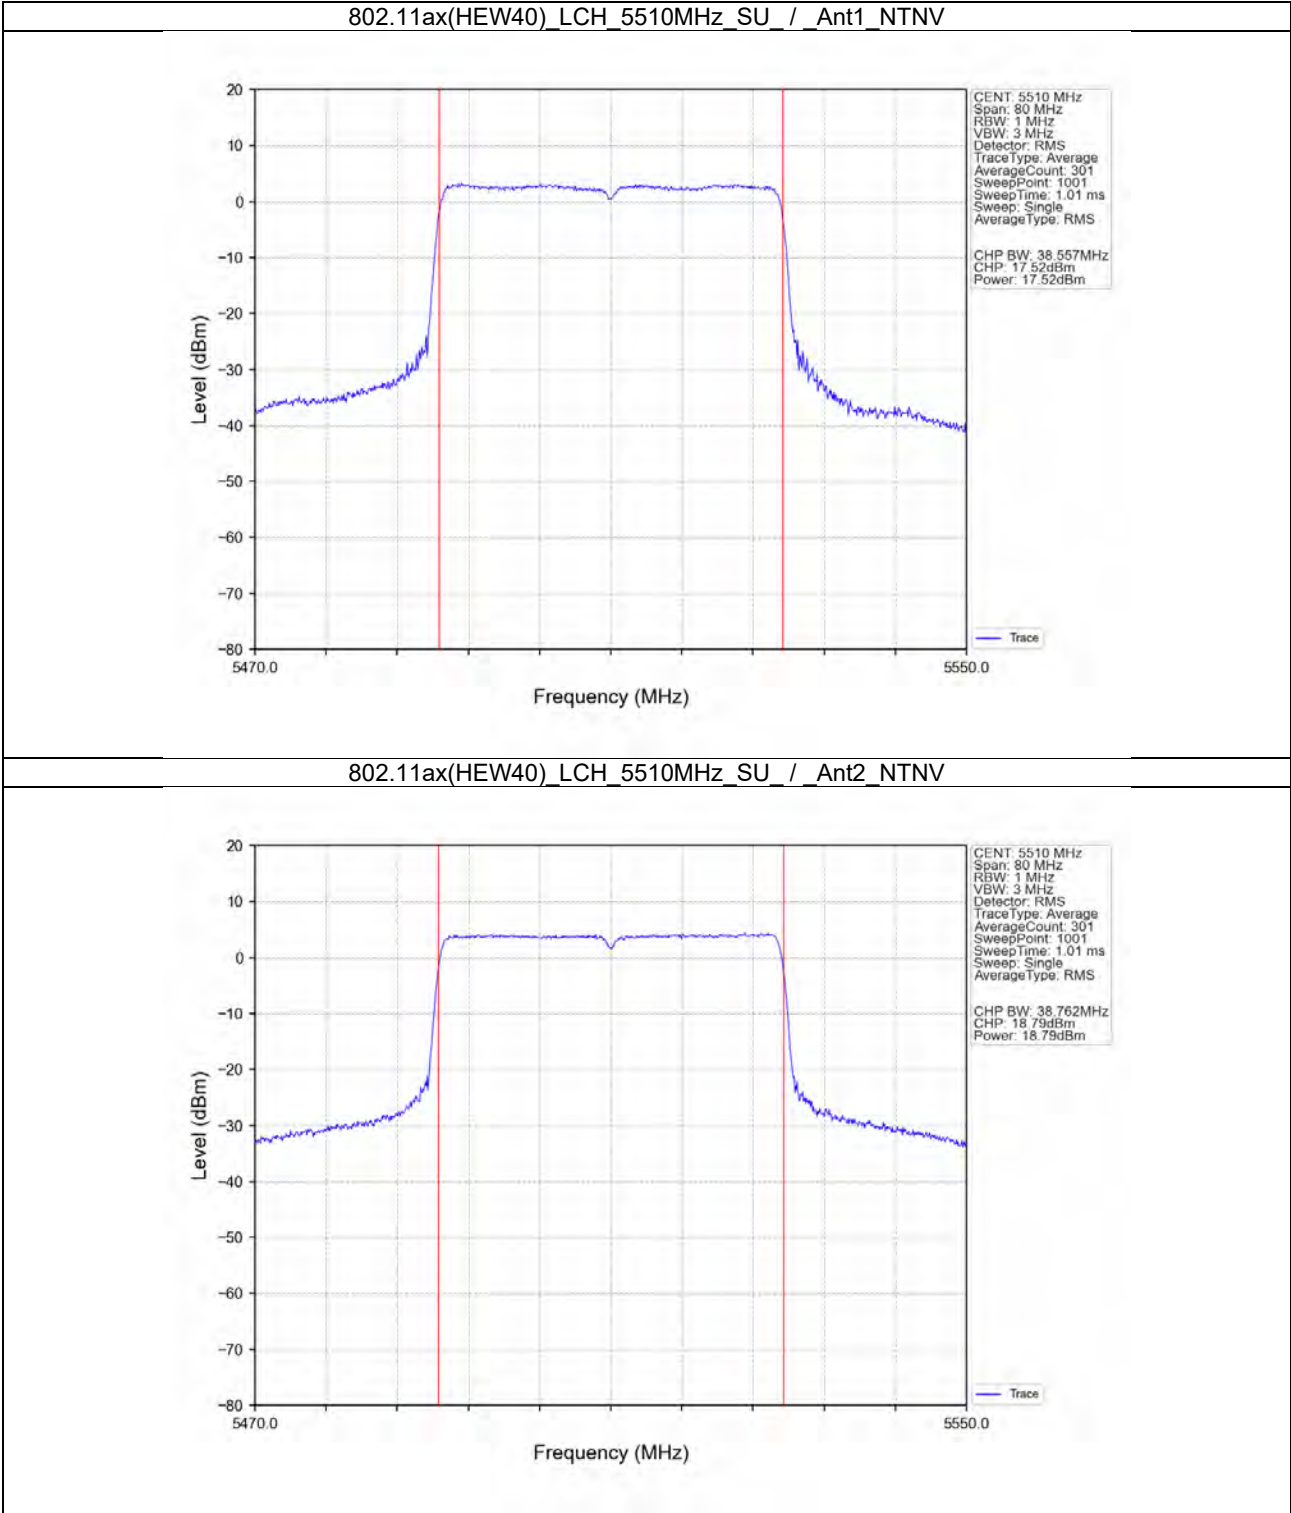



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 314 of 1085

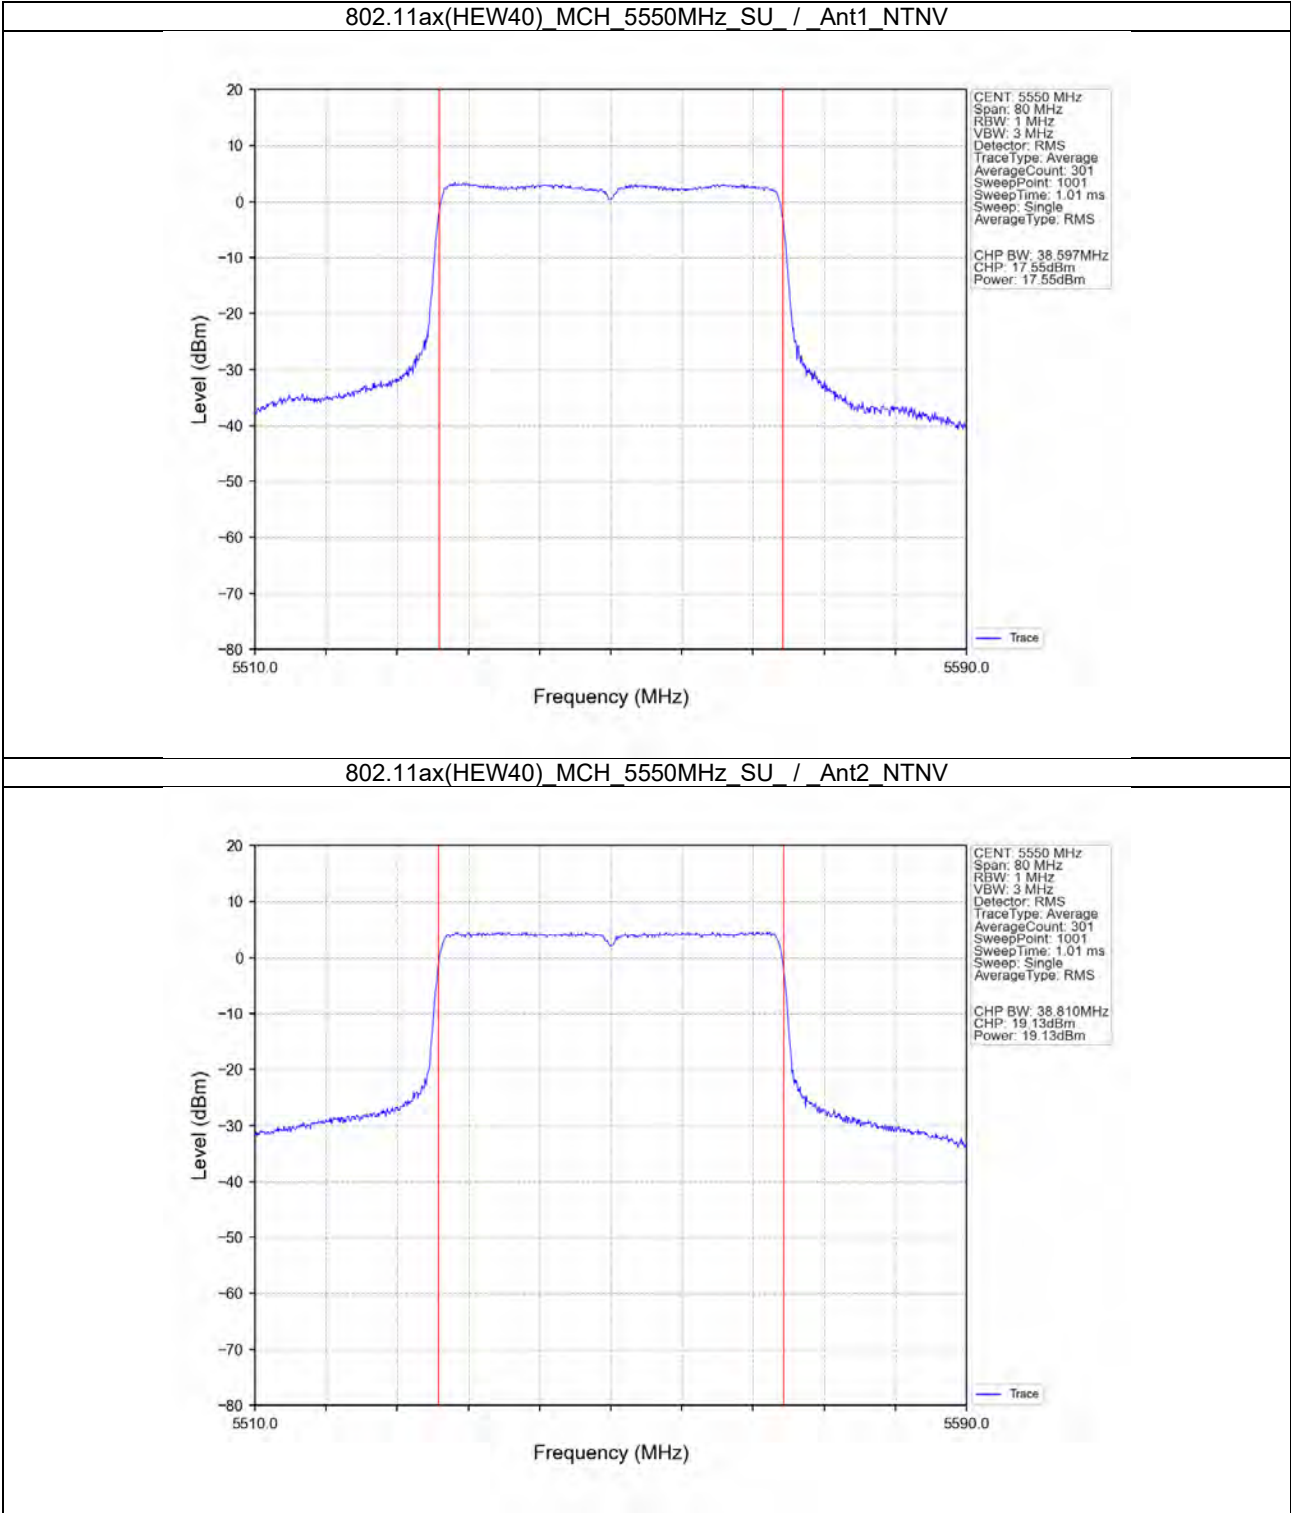



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.

Report No.: SUCR250300017004
Rev.: 01
Page: 315 of 1085

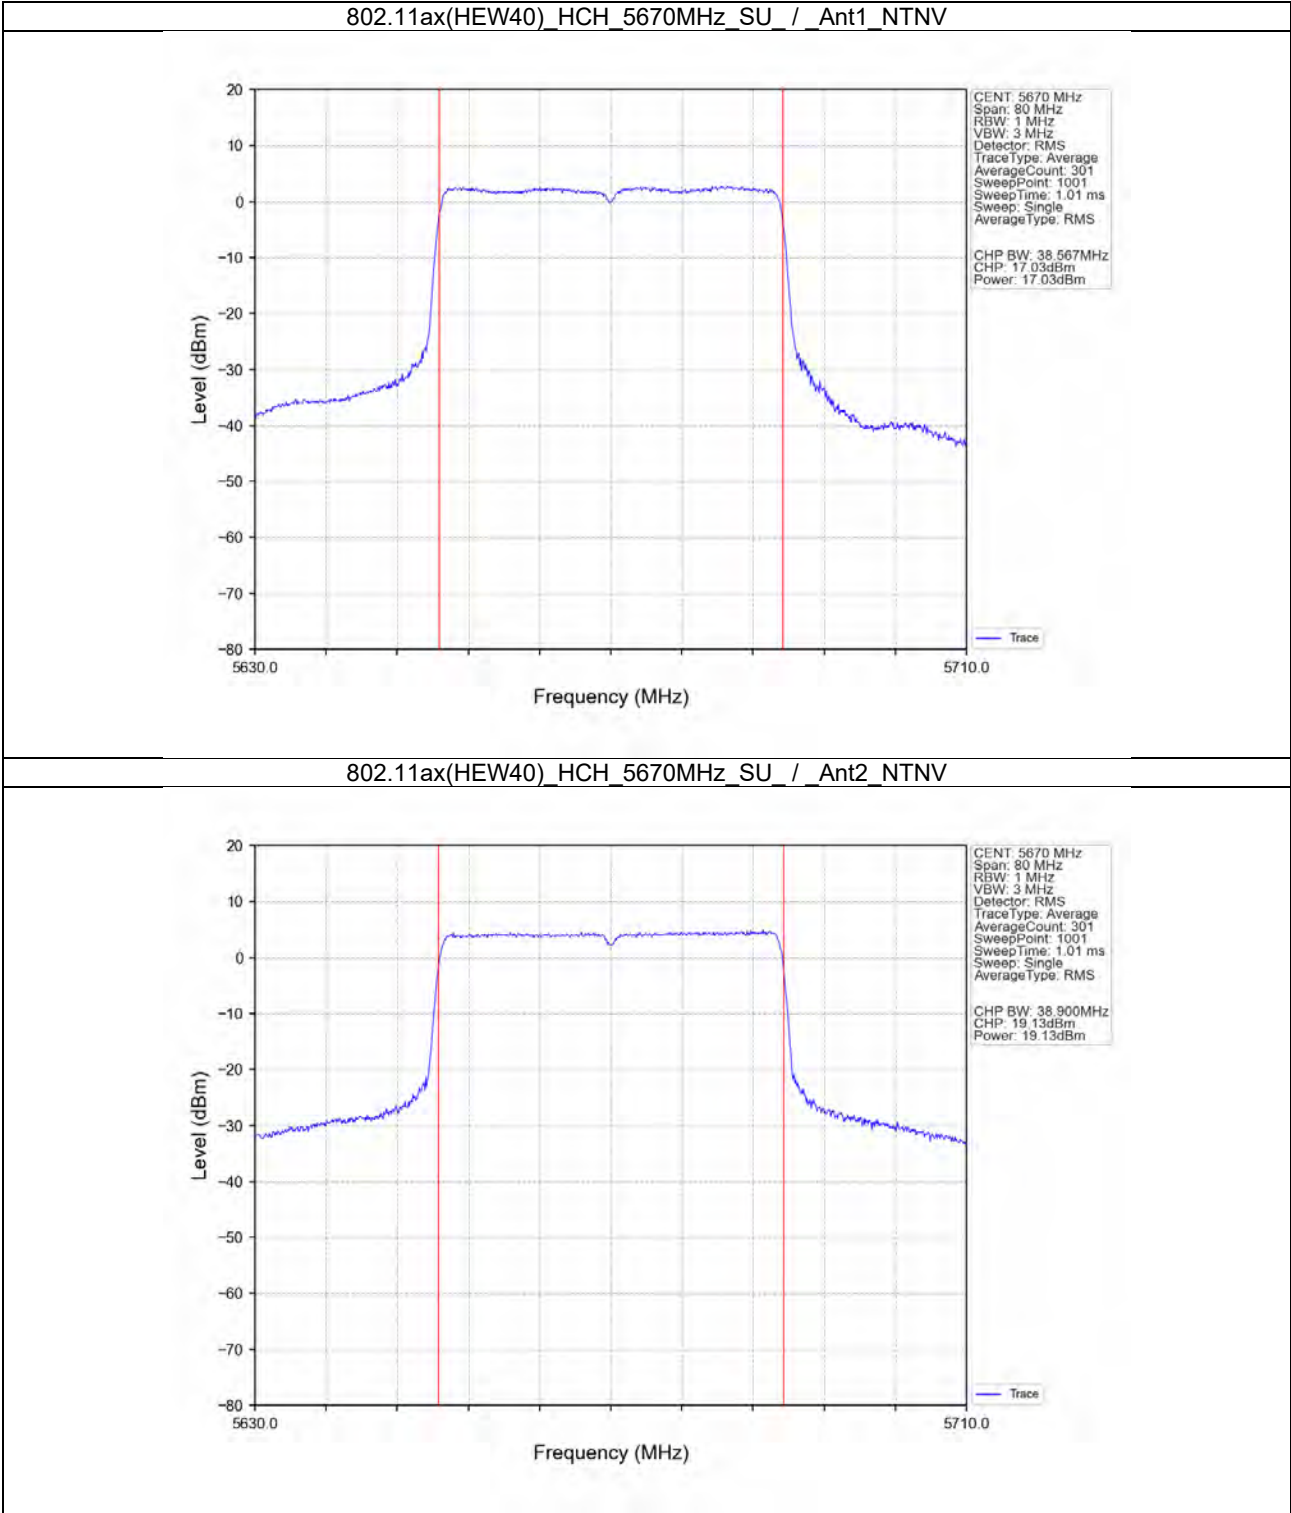





SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.

Report No.: SUCR250300017004
Rev.: 01
Page: 316 of 1085

802.11ax(HEW40)_LCH_5755MHz_SU_/_Ant1_NTNV

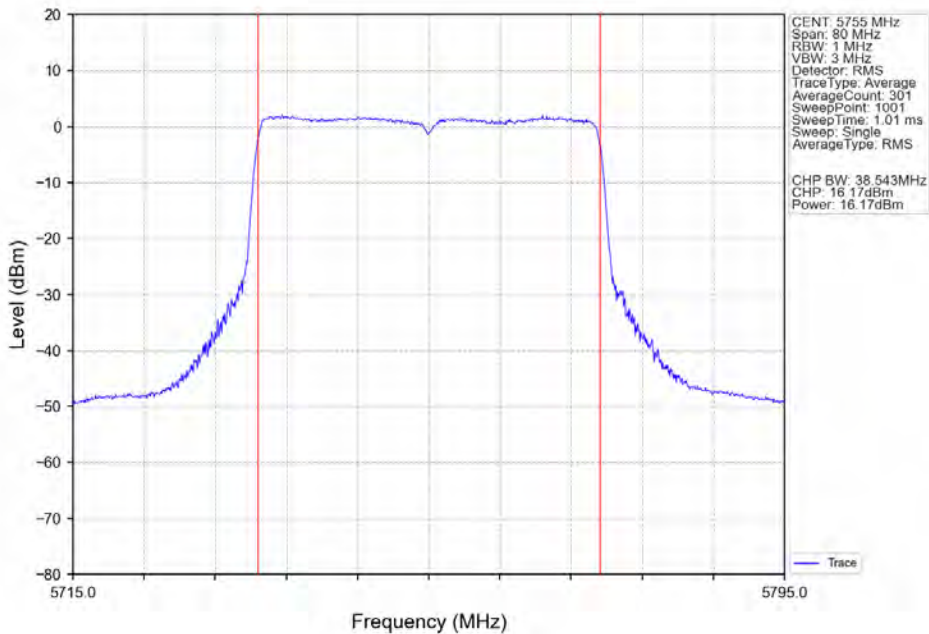

802.11ax(HEW40)_LCH_5755MHz_SU_/_Ant2_NTNV

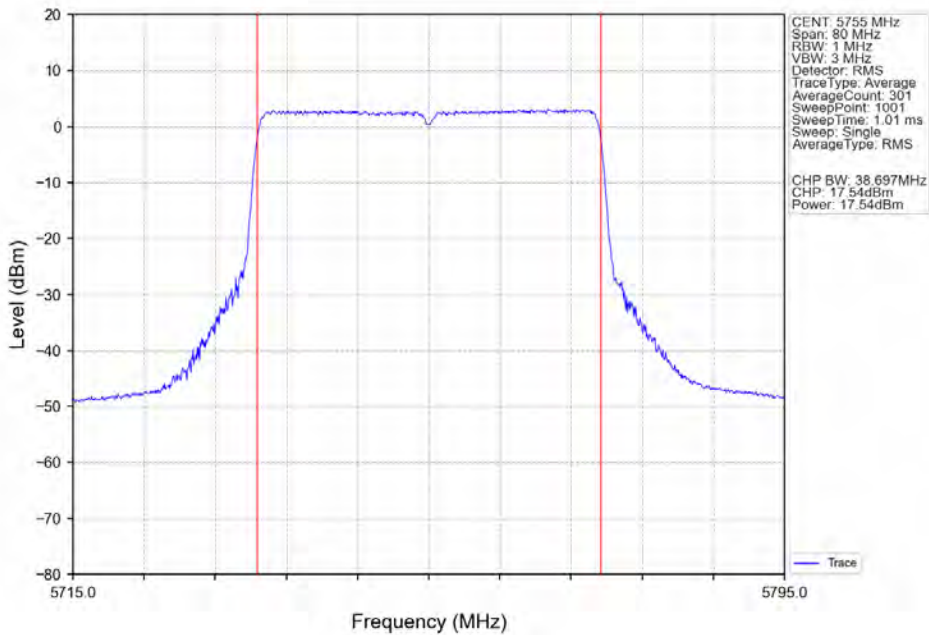





SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.

Report No.: SUCR250300017004
Rev.: 01
Page: 317 of 1085

802.11ax(HEW40)_HCH_5795MHz_SU_/_Ant1_NTNV

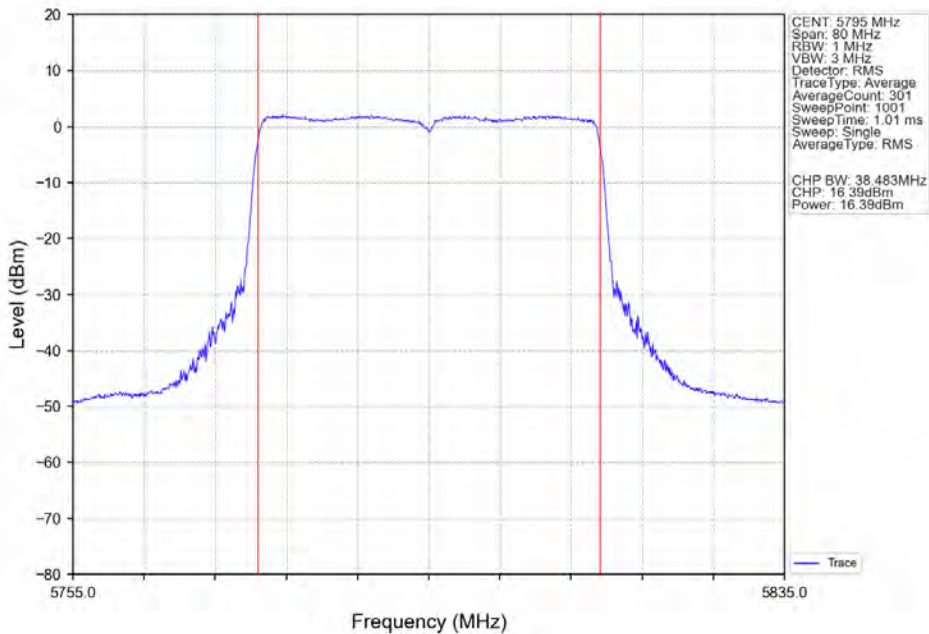


802.11ax(HEW40)_HCH_5795MHz_SU_/_Ant2_NTNV

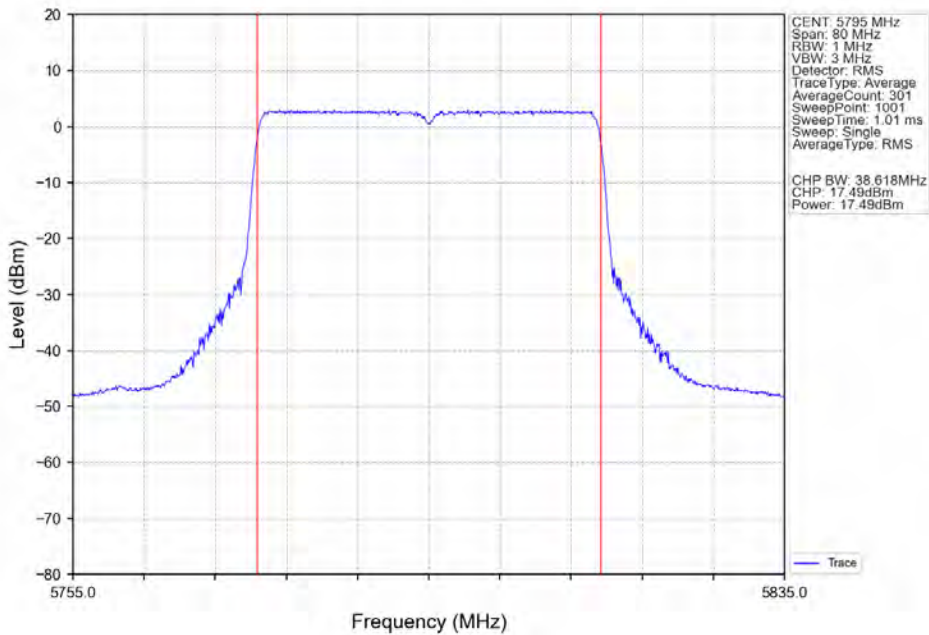



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 318 of 1085

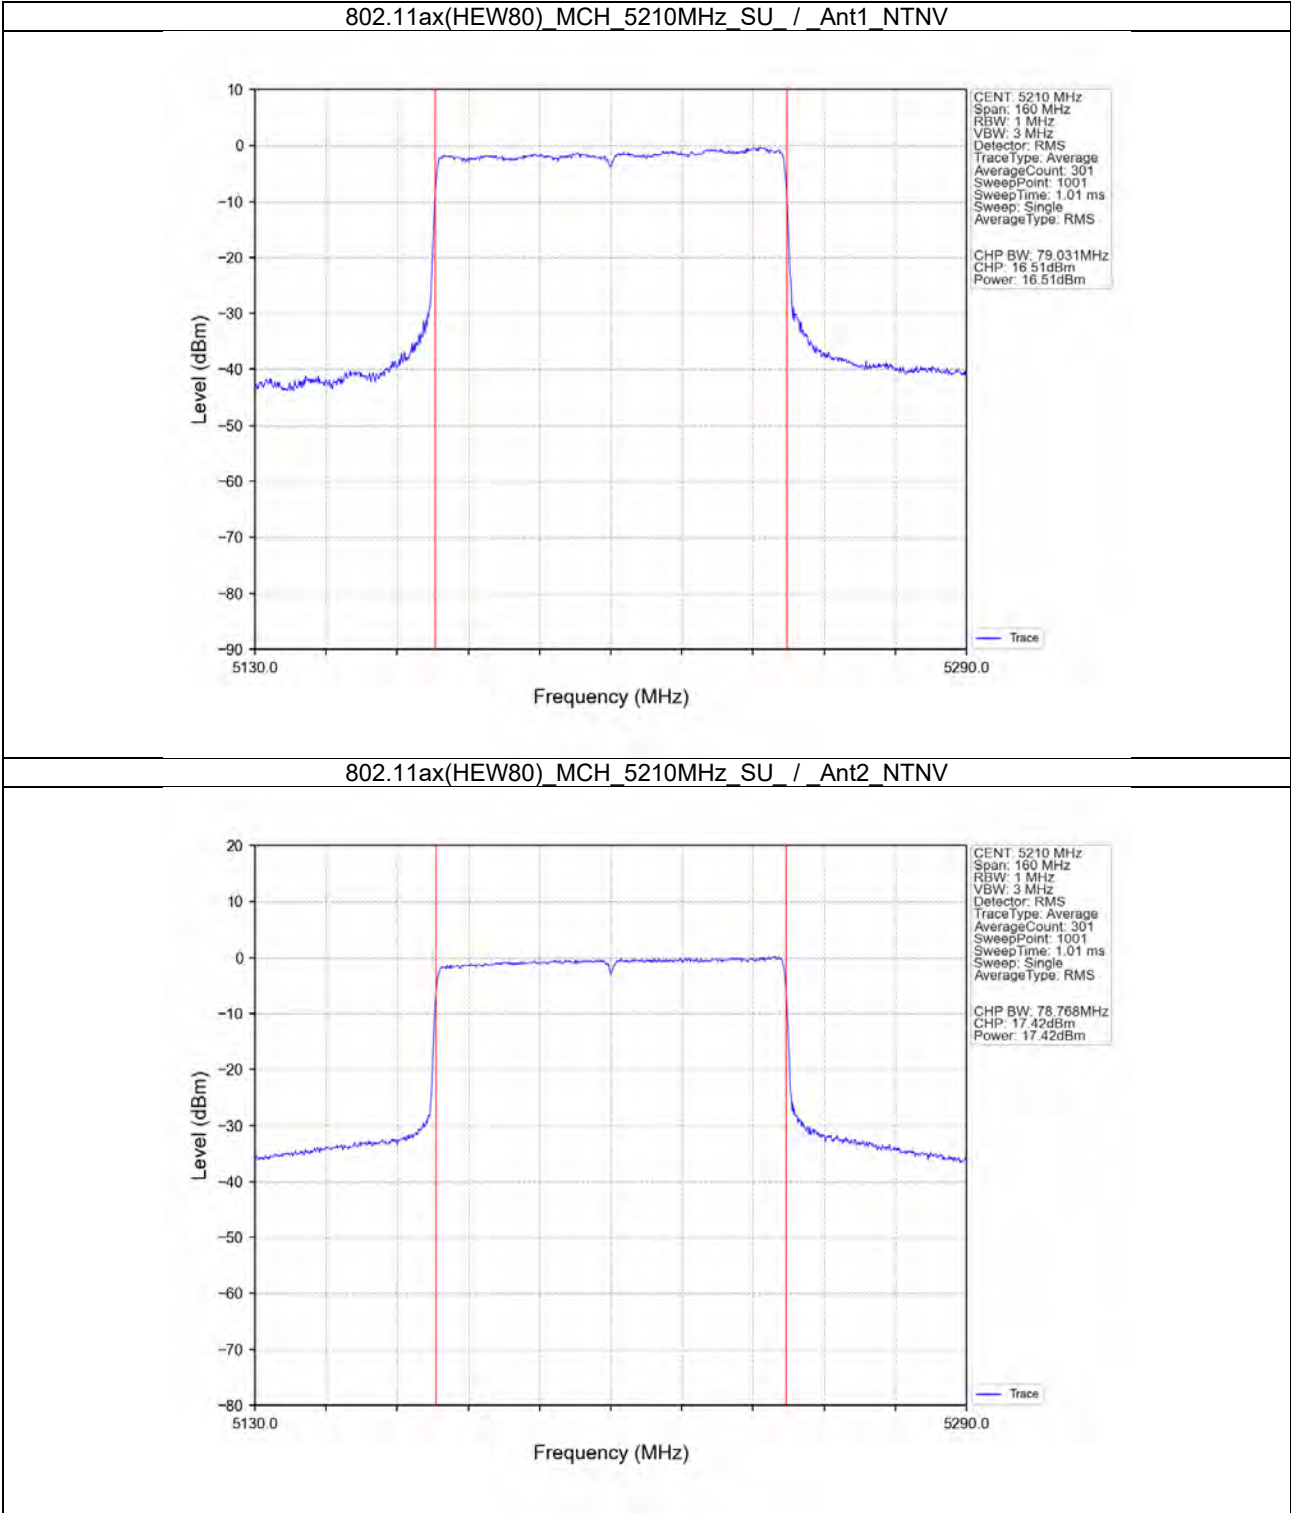



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 319 of 1085

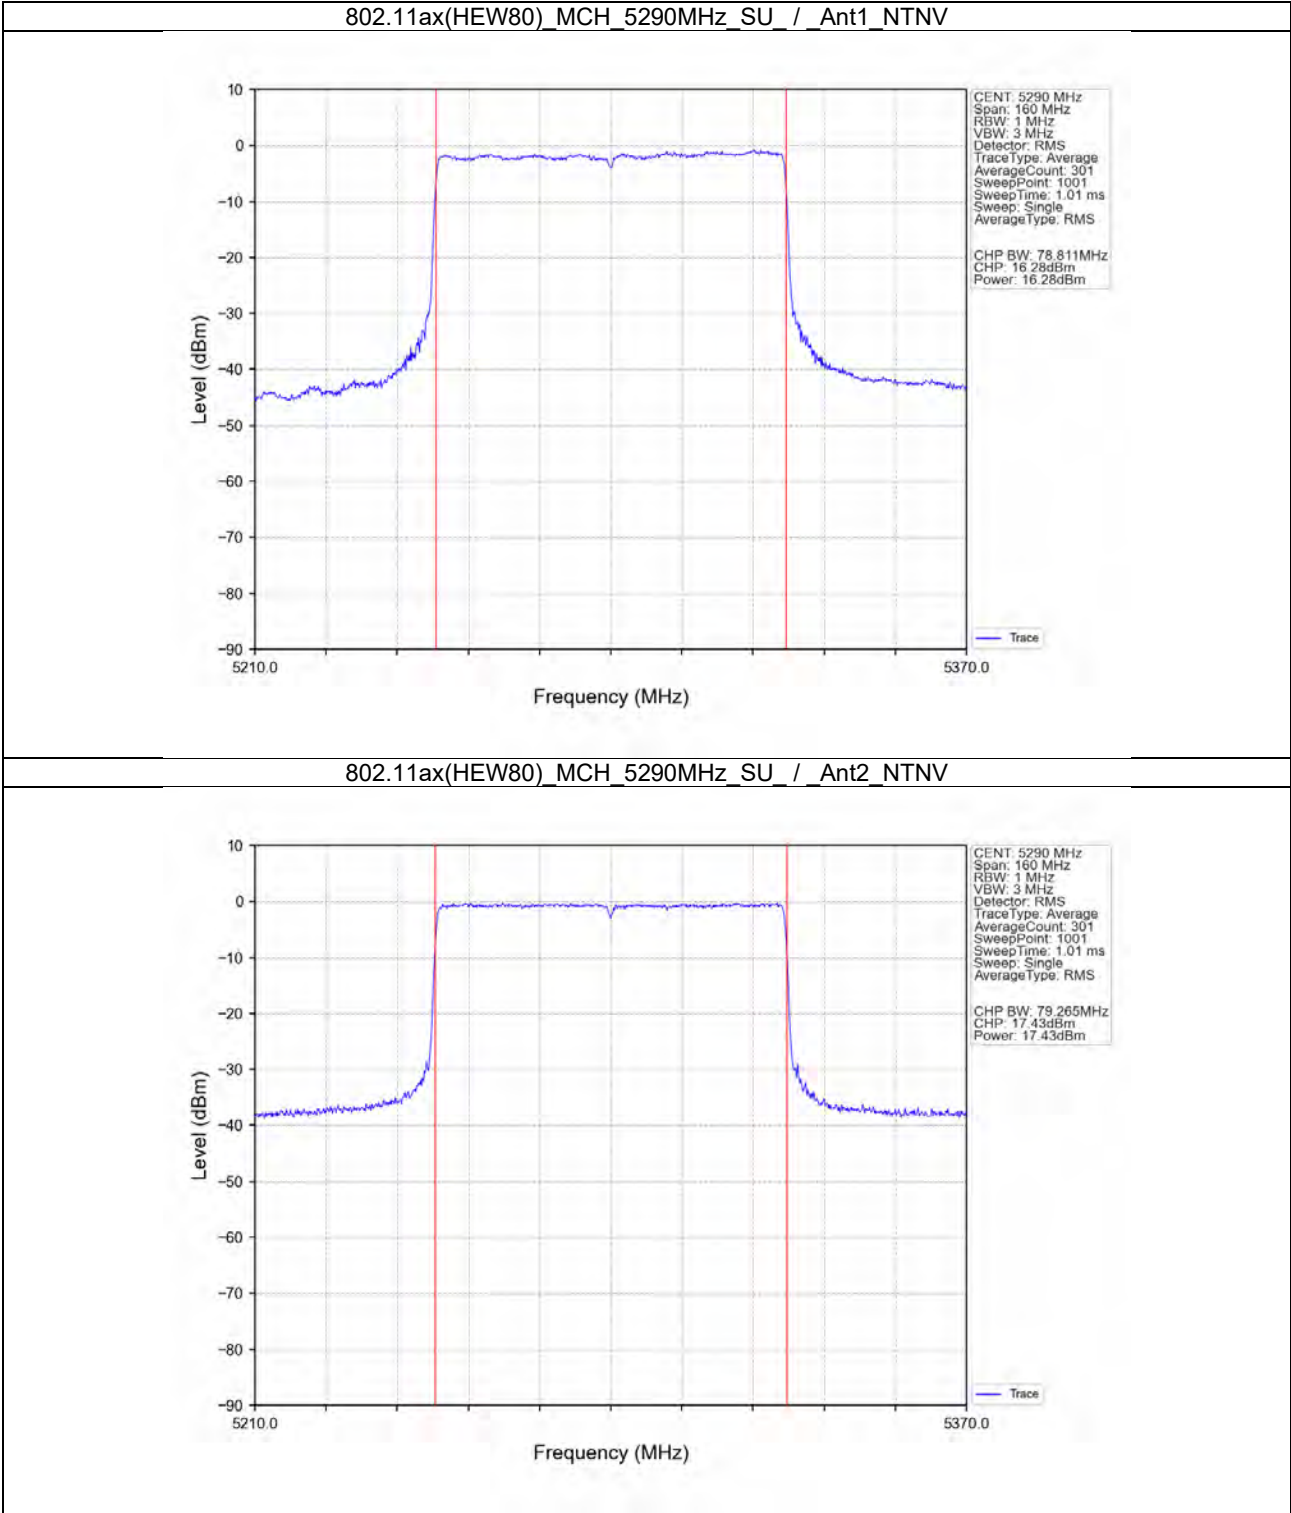



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 320 of 1085

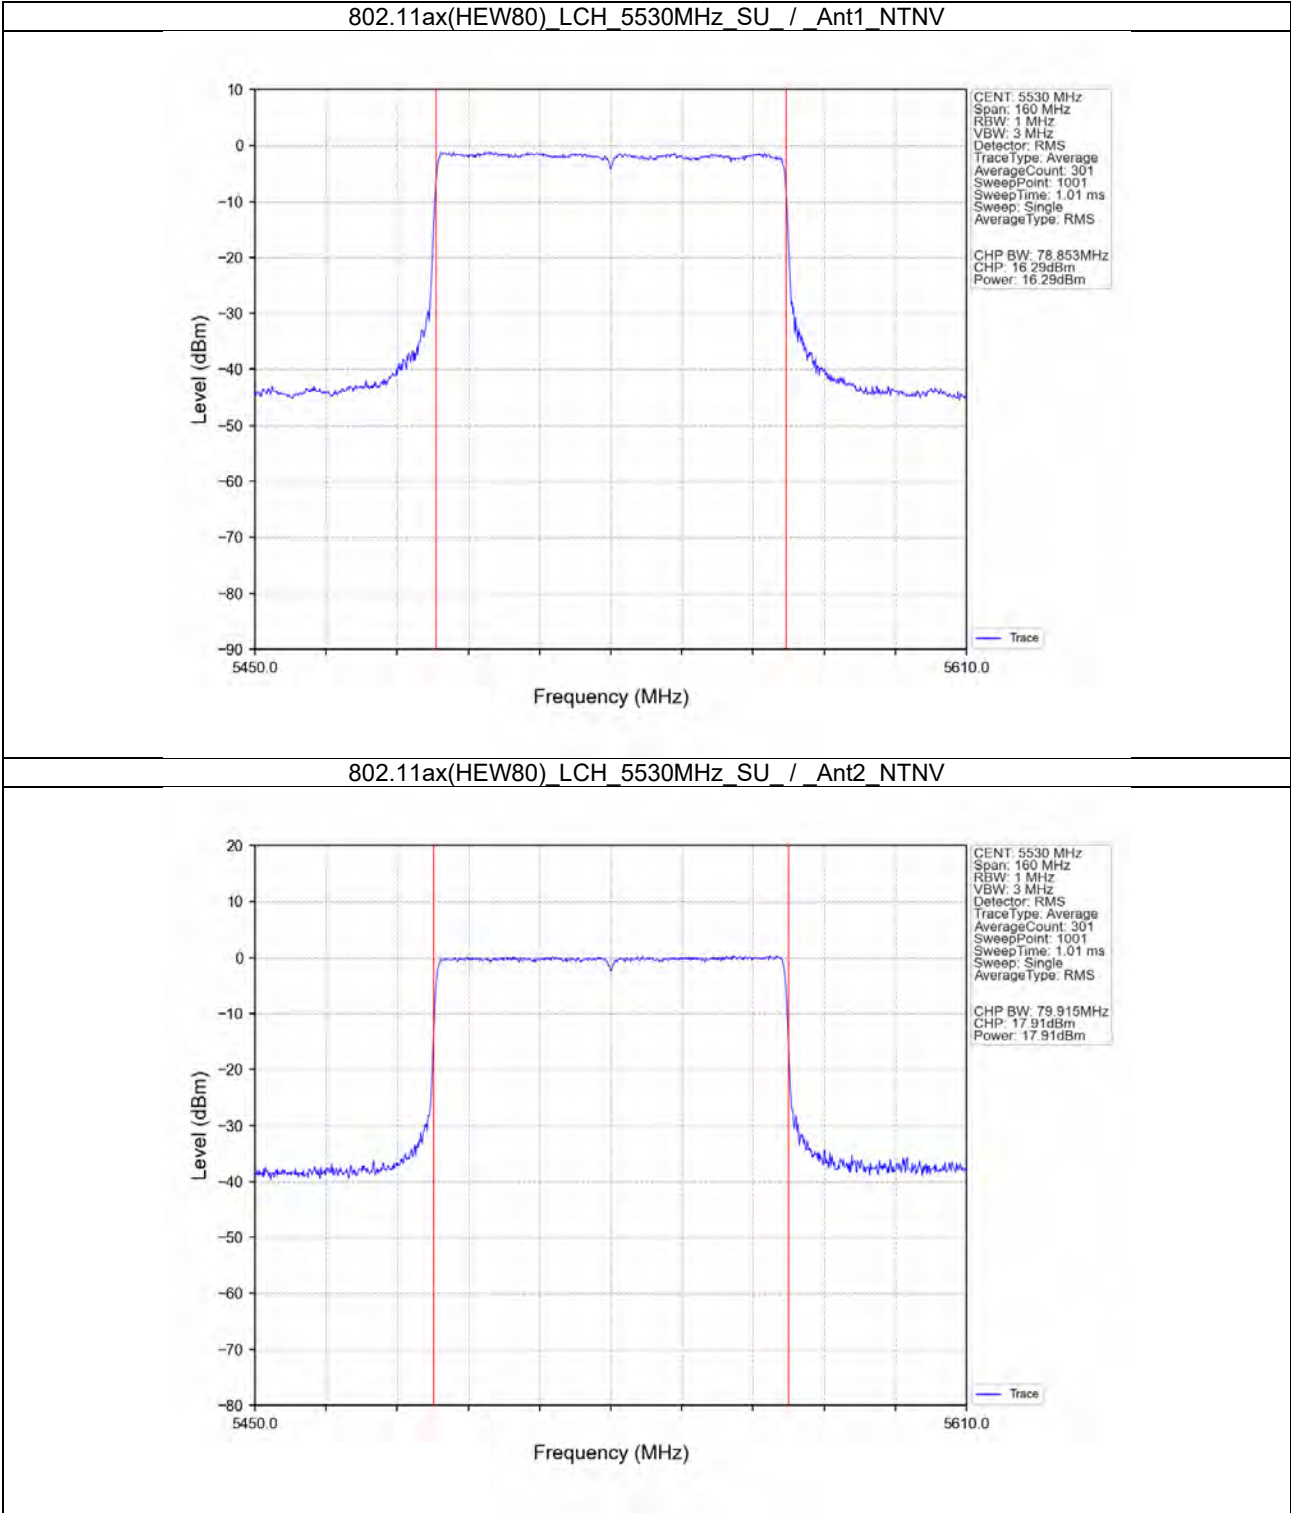



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.

Report No.: SUCR250300017004
Rev.: 01
Page: 321 of 1085

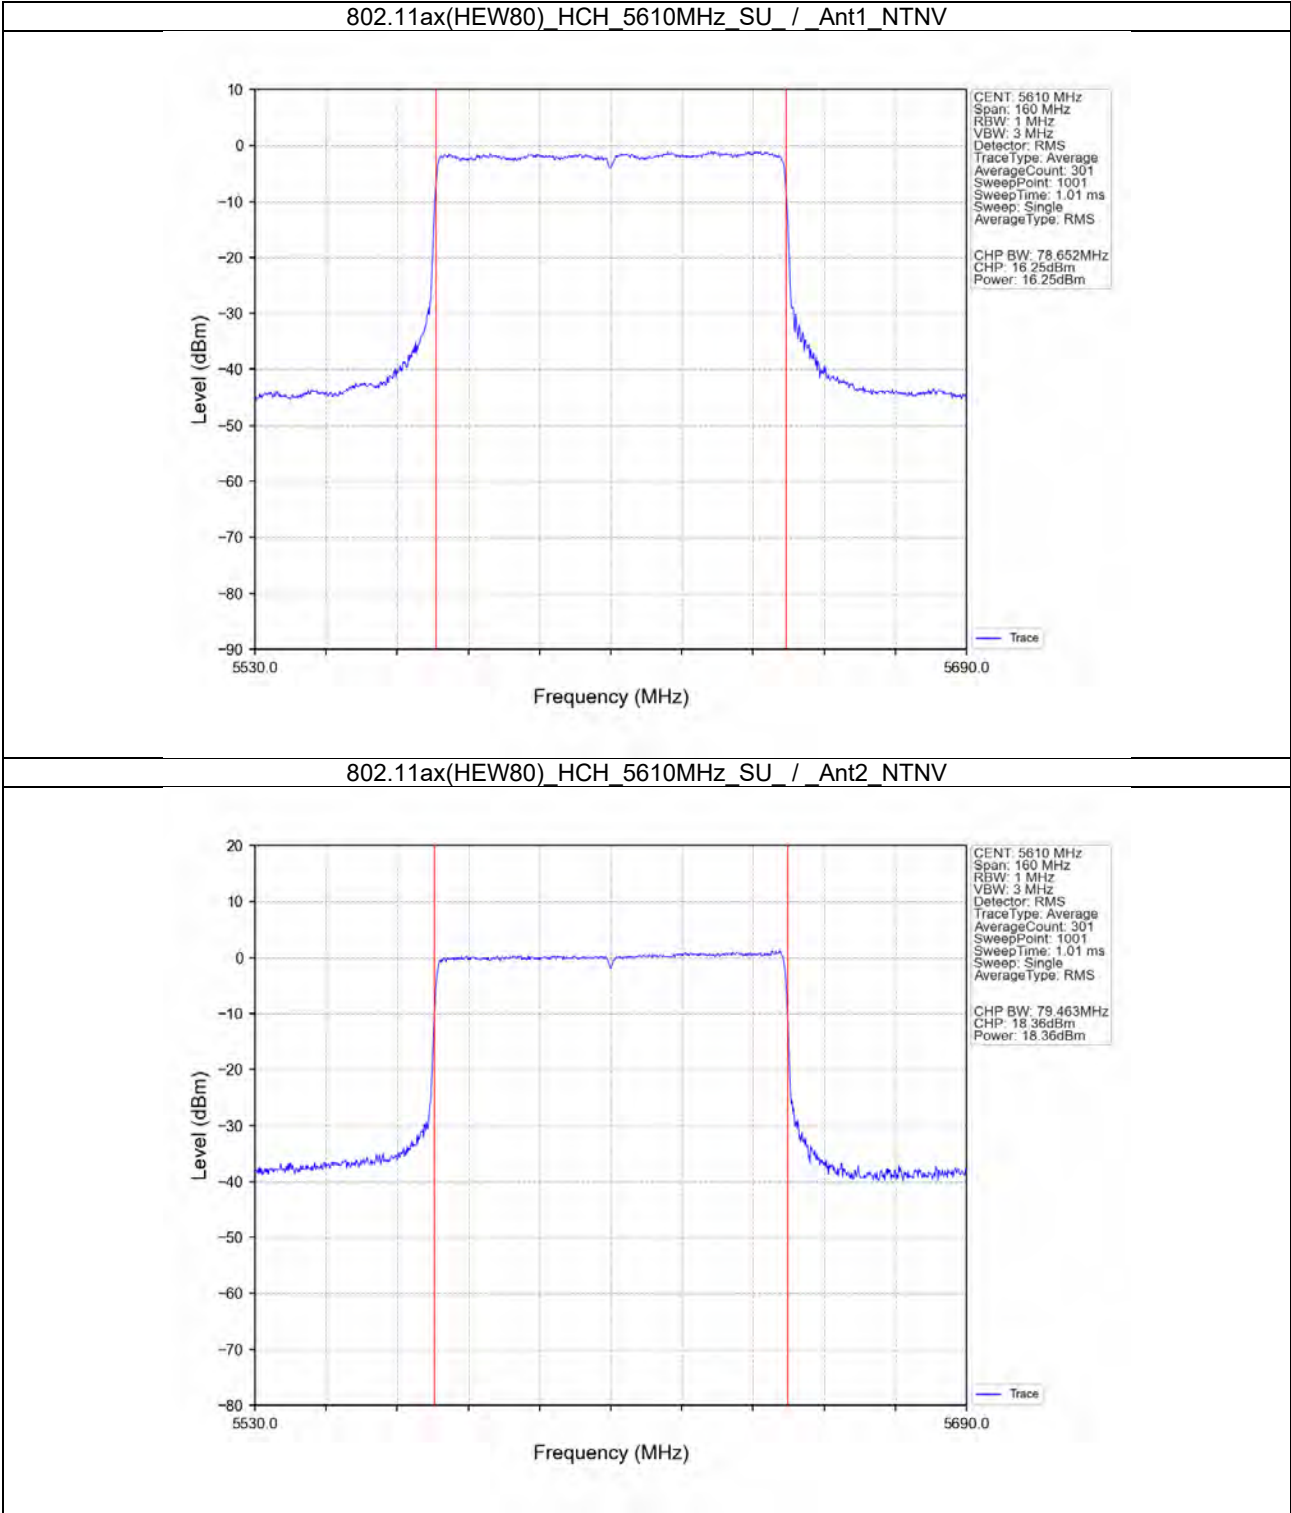





SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.

Report No.: SUCR250300017004
Rev.: 01
Page: 322 of 1085

802.11ax(HEW80)_MCH_5775MHz_SU / _Ant1_NTNV

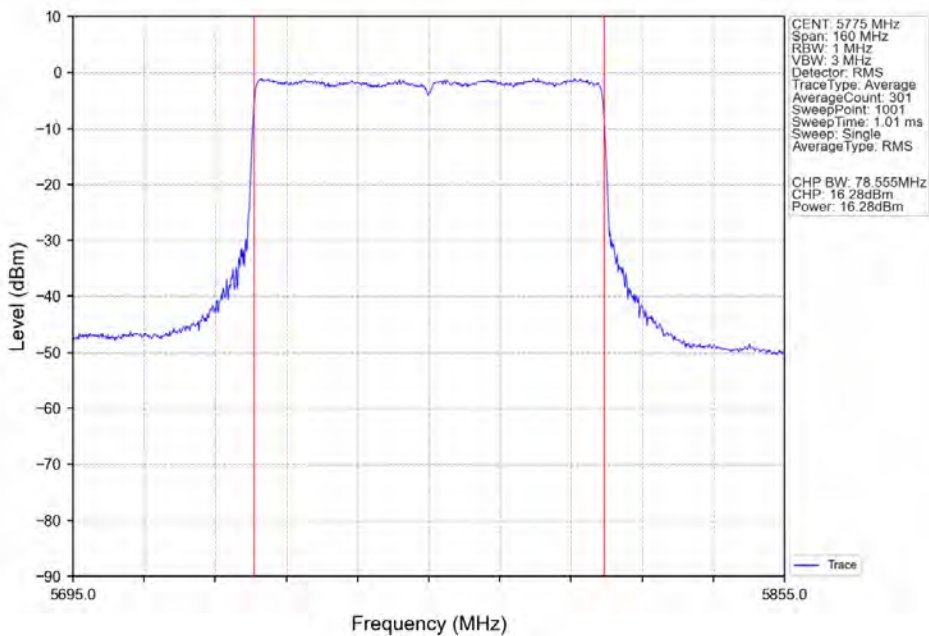


802.11ax(HEW80)_MCH_5775MHz_SU / _Ant2_NTNV

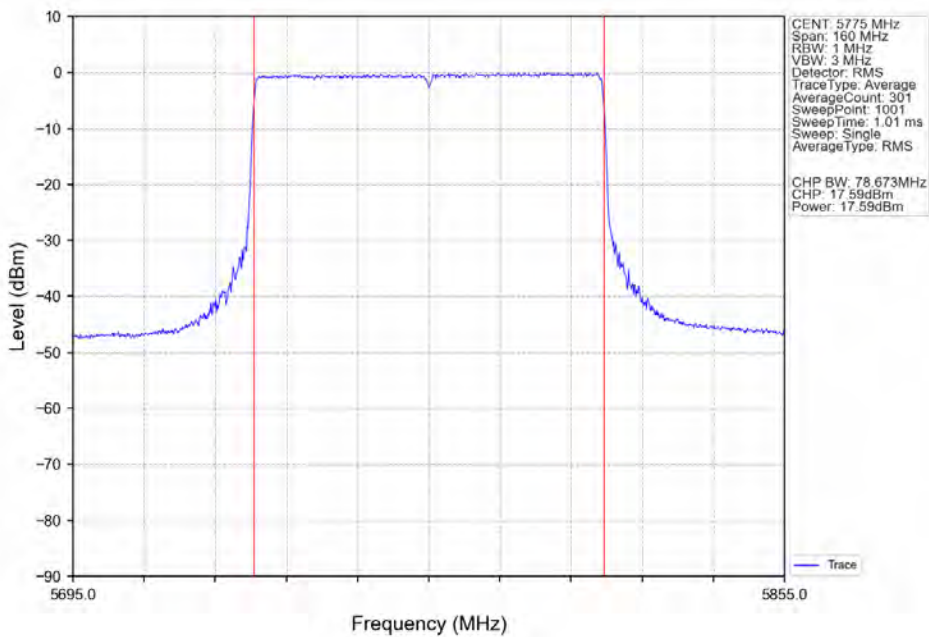



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 323 of 1085

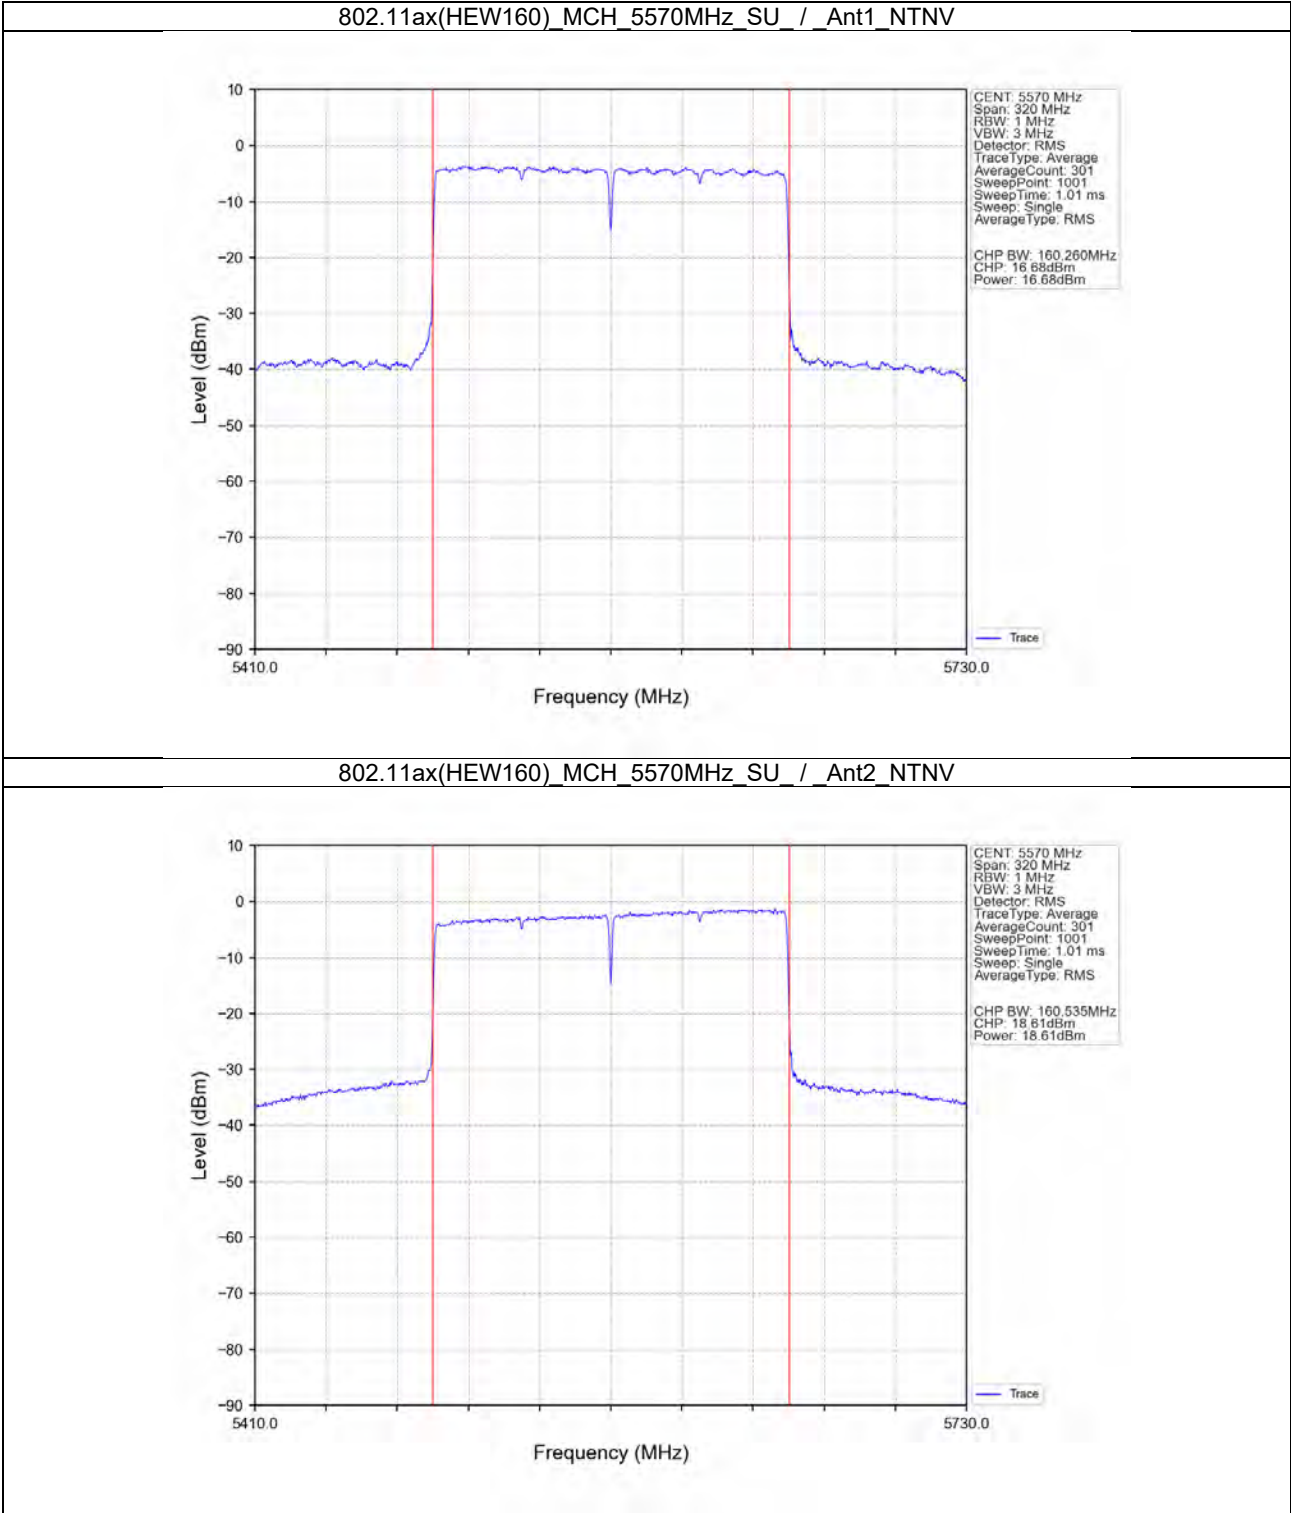



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.

Report No.: SUCR250300017004
Rev.: 01
Page: 324 of 1085

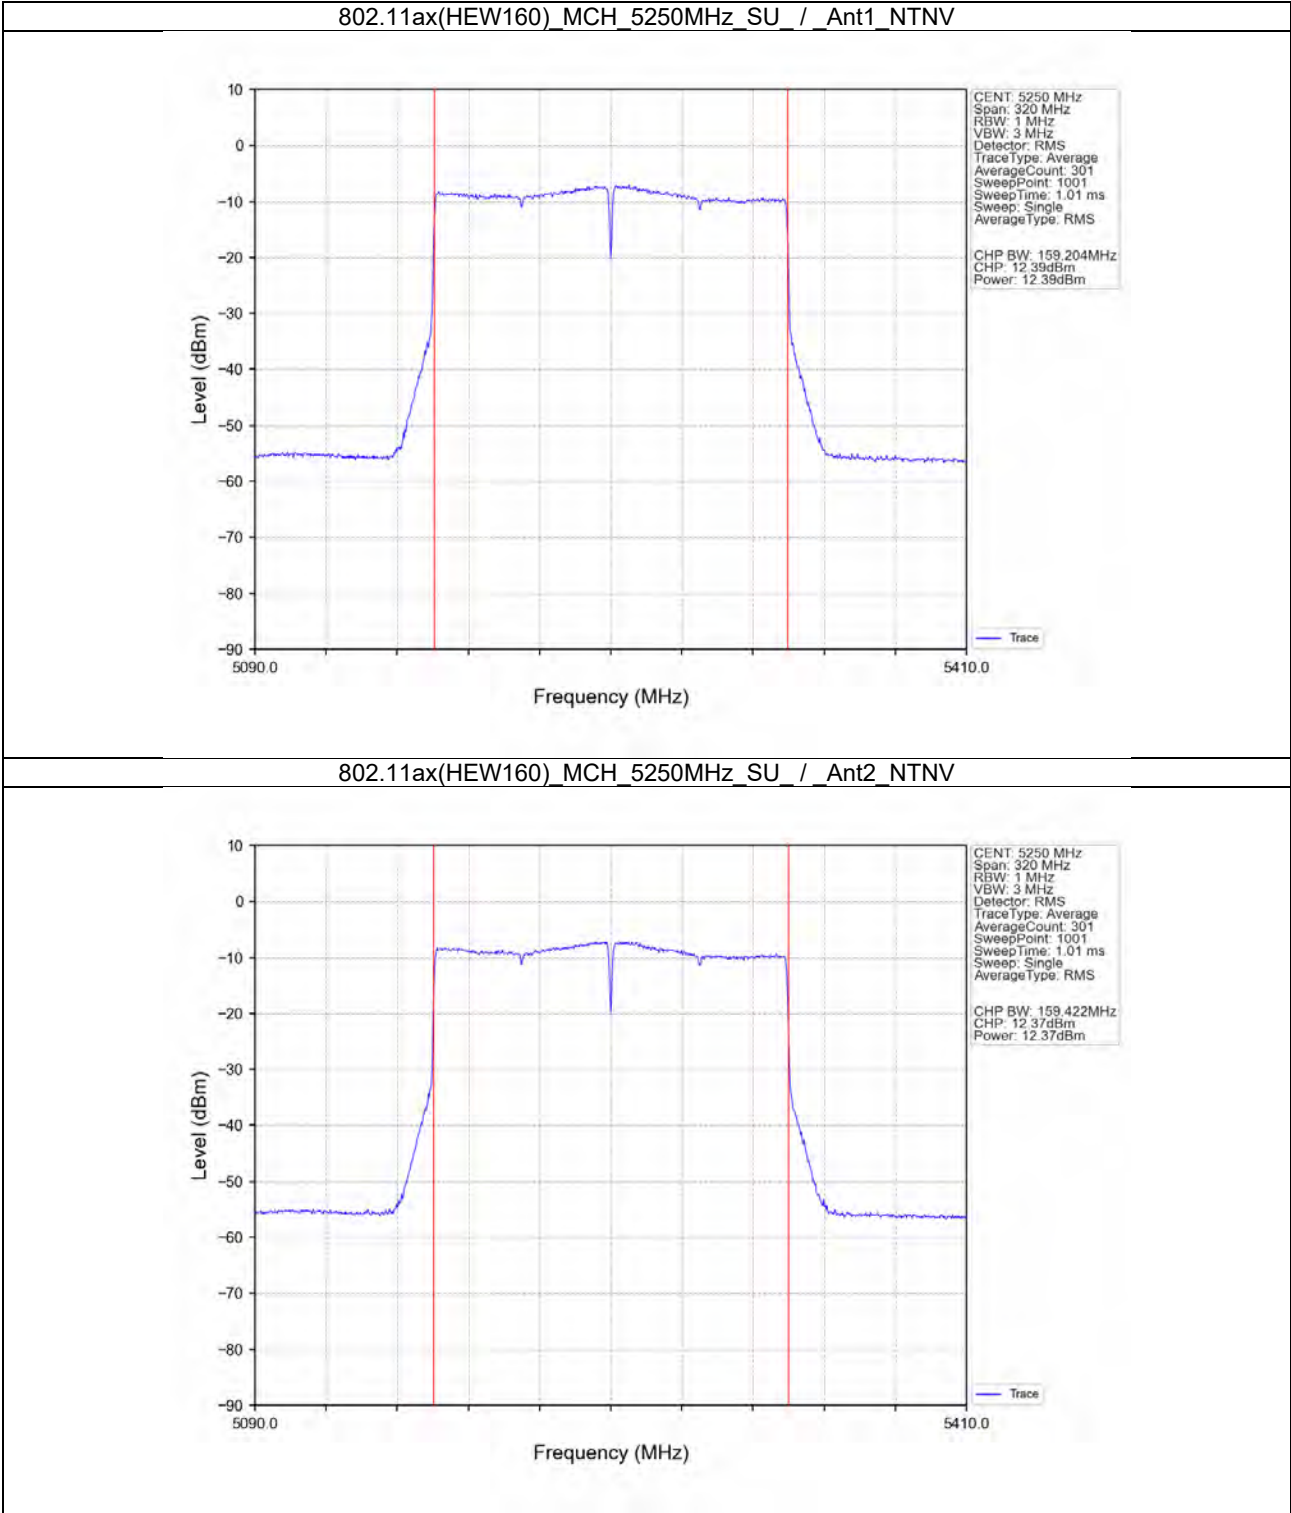



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.

Report No.: SUCR250300017004

Rev.: 01

Page: 325 of 1085

4. Maximum Power Spectral Density

4.1 Test Result

4.1.1 PSD

Mode	TX Type	Frequency (MHz)	RU	RU Pos	Maximum PSD (dBm/MHz)				Verdict
					ANT1	ANT2	MIMO	Limit	
802.11a	MIMO	5180	/	/	7.22	6.55	9.76	<=11	Pass
		5200	/	/	7.63	6.42	9.91	<=11	Pass
		5240	/	/	7.38	6.74	9.86	<=11	Pass
		5260	/	/	7.55	6.22	9.78	<=11	Pass
		5300	/	/	7.44	5.93	9.61	<=11	Pass
		5320	/	/	7.36	6.28	9.73	<=11	Pass
		5500	/	/	7.41	5.74	9.42	<=11	Pass
		5580	/	/	7.87	6.11	10.00	<=11	Pass
802.11n (HT20)	MIMO	5700	/	/	7.68	6.26	9.86	<=11	Pass
		5180	/	/	5.07	5.10	7.93	<=11	Pass
		5200	/	/	5.67	6.16	8.88	<=11	Pass
		5240	/	/	5.89	6.01	8.84	<=11	Pass
		5260	/	/	7.06	7.67	10.27	<=11	Pass
		5300	/	/	5.82	5.97	8.70	<=11	Pass
		5320	/	/	5.81	5.92	8.71	<=11	Pass
		5500	/	/	5.72	6.81	9.07	<=11	Pass
802.11n (HT40)	MIMO	5580	/	/	5.62	7.00	9.23	<=11	Pass
		5700	/	/	5.45	6.70	8.91	<=11	Pass
		5190	/	/	3.79	4.56	6.99	<=11	Pass
		5230	/	/	3.66	4.61	6.99	<=11	Pass
		5270	/	/	3.71	4.84	7.12	<=11	Pass
		5310	/	/	3.91	4.15	6.88	<=11	Pass
		5510	/	/	3.66	4.99	7.27	<=11	Pass
		5550	/	/	3.48	5.25	7.40	<=11	Pass
802.11ac (VHT20)	MIMO	5670	/	/	3.22	5.49	7.35	<=11	Pass
		5180	/	/	7.02	7.04	9.94	<=11	Pass
		5200	/	/	4.95	5.42	8.03	<=11	Pass
		5240	/	/	4.86	5.28	7.92	<=11	Pass
		5260	/	/	5.91	6.19	8.91	<=11	Pass
		5300	/	/	5.73	6.08	8.55	<=11	Pass
		5320	/	/	5.80	5.90	8.61	<=11	Pass
		5500	/	/	5.63	6.67	9.02	<=11	Pass
802.11ac (VHT40)	MIMO	5580	/	/	5.37	6.96	9.08	<=11	Pass
		5700	/	/	5.31	6.78	9.00	<=11	Pass
		5190	/	/	3.61	4.43	6.93	<=11	Pass
		5230	/	/	3.47	4.49	6.88	<=11	Pass
		5270	/	/	3.53	4.68	7.09	<=11	Pass
		5310	/	/	3.83	4.02	6.76	<=11	Pass
		5510	/	/	3.60	4.85	7.08	<=11	Pass
		5550	/	/	3.62	5.07	7.33	<=11	Pass
802.11ac (VHT80)	MIMO	5670	/	/	3.09	5.11	7.10	<=11	Pass
		5210	/	/	0.55	1.34	3.76	<=11	Pass
		5290	/	/	0.23	1.18	3.56	<=11	Pass
		5530	/	/	0.37	1.81	4.01	<=11	Pass
802.11ac (VHT160)	MIMO	5610	/	/	0.18	2.25	4.13	<=11	Pass
		5570	/	/	-3.63	-1.36	0.29	<=11	Pass
802.11ax	MIMO	5250	/	/	-7.52	-7.66	-4.63	<=11	Pass
		5180	SU	/	5.43	5.42	8.09	<=11	Pass



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.

Report No.: SUCR250300017004

Rev.: 01

Page: 326 of 1085

(HEW20)		5200	SU	/	5.14	5.55	8.23	<=11	Pass
		5240	SU	/	5.13	5.52	8.12	<=11	Pass
		5260	SU	/	5.20	5.79	8.25	<=11	Pass
		5300	SU	/	5.08	5.32	7.96	<=11	Pass
		5320	SU	/	5.35	5.18	8.03	<=11	Pass
		5500	SU	/	4.91	6.14	8.32	<=11	Pass
		5580	SU	/	4.62	6.44	8.47	<=11	Pass
		5700	SU	/	4.88	6.10	8.39	<=11	Pass
802.11ax (HEW40)	MIMO	5190	SU	/	3.49	4.19	6.64	<=11	Pass
		5230	SU	/	3.22	4.24	6.69	<=11	Pass
		5270	SU	/	3.20	4.24	6.53	<=11	Pass
		5310	SU	/	3.52	3.60	6.35	<=11	Pass
		5510	SU	/	3.22	4.43	6.63	<=11	Pass
		5550	SU	/	3.24	4.66	6.87	<=11	Pass
		5670	SU	/	2.77	4.85	6.66	<=11	Pass
802.11ax (HEW80)	MIMO	5210	SU	/	-0.39	0.37	2.83	<=11	Pass
		5290	SU	/	-0.87	-0.15	2.38	<=11	Pass
		5530	SU	/	-0.86	0.37	2.44	<=11	Pass
		5610	SU	/	-0.97	1.28	3.00	<=11	Pass
802.11ax (HEW160)	MIMO	5570	SU	/	-3.59	-1.28	0.27	<=11	Pass
		5250	SU	/	-7.06	-7.22	-4.30	<=11	Pass

4.1.2 PSD-Band3

Mode	TX Type	Frequency (MHz)	RU	RU Pos	Maximum PSD (dBm/500kHz)				Verdict
					ANT1	ANT2	MIMO	Limit	
802.11a	MIMO	5745	/	/	4.71	3.16	6.78	<=30	Pass
		5785	/	/	4.65	3.46	6.97	<=30	Pass
		5825	/	/	4.45	2.88	6.64	<=30	Pass
802.11n (HT20)	MIMO	5745	/	/	2.49	3.85	6.17	<=30	Pass
		5785	/	/	2.83	4.05	6.34	<=30	Pass
		5825	/	/	2.47	3.68	6.05	<=30	Pass
802.11n (HT40)	MIMO	5755	/	/	-0.73	0.82	3.01	<=30	Pass
		5795	/	/	-0.25	0.89	3.33	<=30	Pass
802.11ac (VHT20)	MIMO	5745	/	/	2.57	2.13	5.28	<=30	Pass
		5785	/	/	2.72	2.95	5.67	<=30	Pass
		5825	/	/	2.66	2.73	5.51	<=30	Pass
802.11ac (VHT40)	MIMO	5755	/	/	-0.05	-1.12	2.33	<=30	Pass
		5795	/	/	-0.19	-1.22	2.13	<=30	Pass
802.11ac (VHT80)	MIMO	5775	/	/	-3.93	-2.56	-0.36	<=30	Pass
802.11ax (HEW20)	MIMO	5745	SU	/	2.17	3.29	5.59	<=30	Pass
		5785	SU	/	2.22	3.62	5.54	<=30	Pass
		5825	SU	/	2.35	2.87	5.48	<=30	Pass
802.11ax (HEW40)	MIMO	5755	SU	/	-0.84	0.28	2.47	<=30	Pass
		5795	SU	/	-0.61	0.24	2.56	<=30	Pass
802.11ax (HEW80)	MIMO	5775	SU	/	-3.94	-2.67	-0.56	<=30	Pass




SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.

Report No.: SUCR250300017004
Rev.: 01
Page: 327 of 1085

4.2 Test Graph


4.2.1 PSD

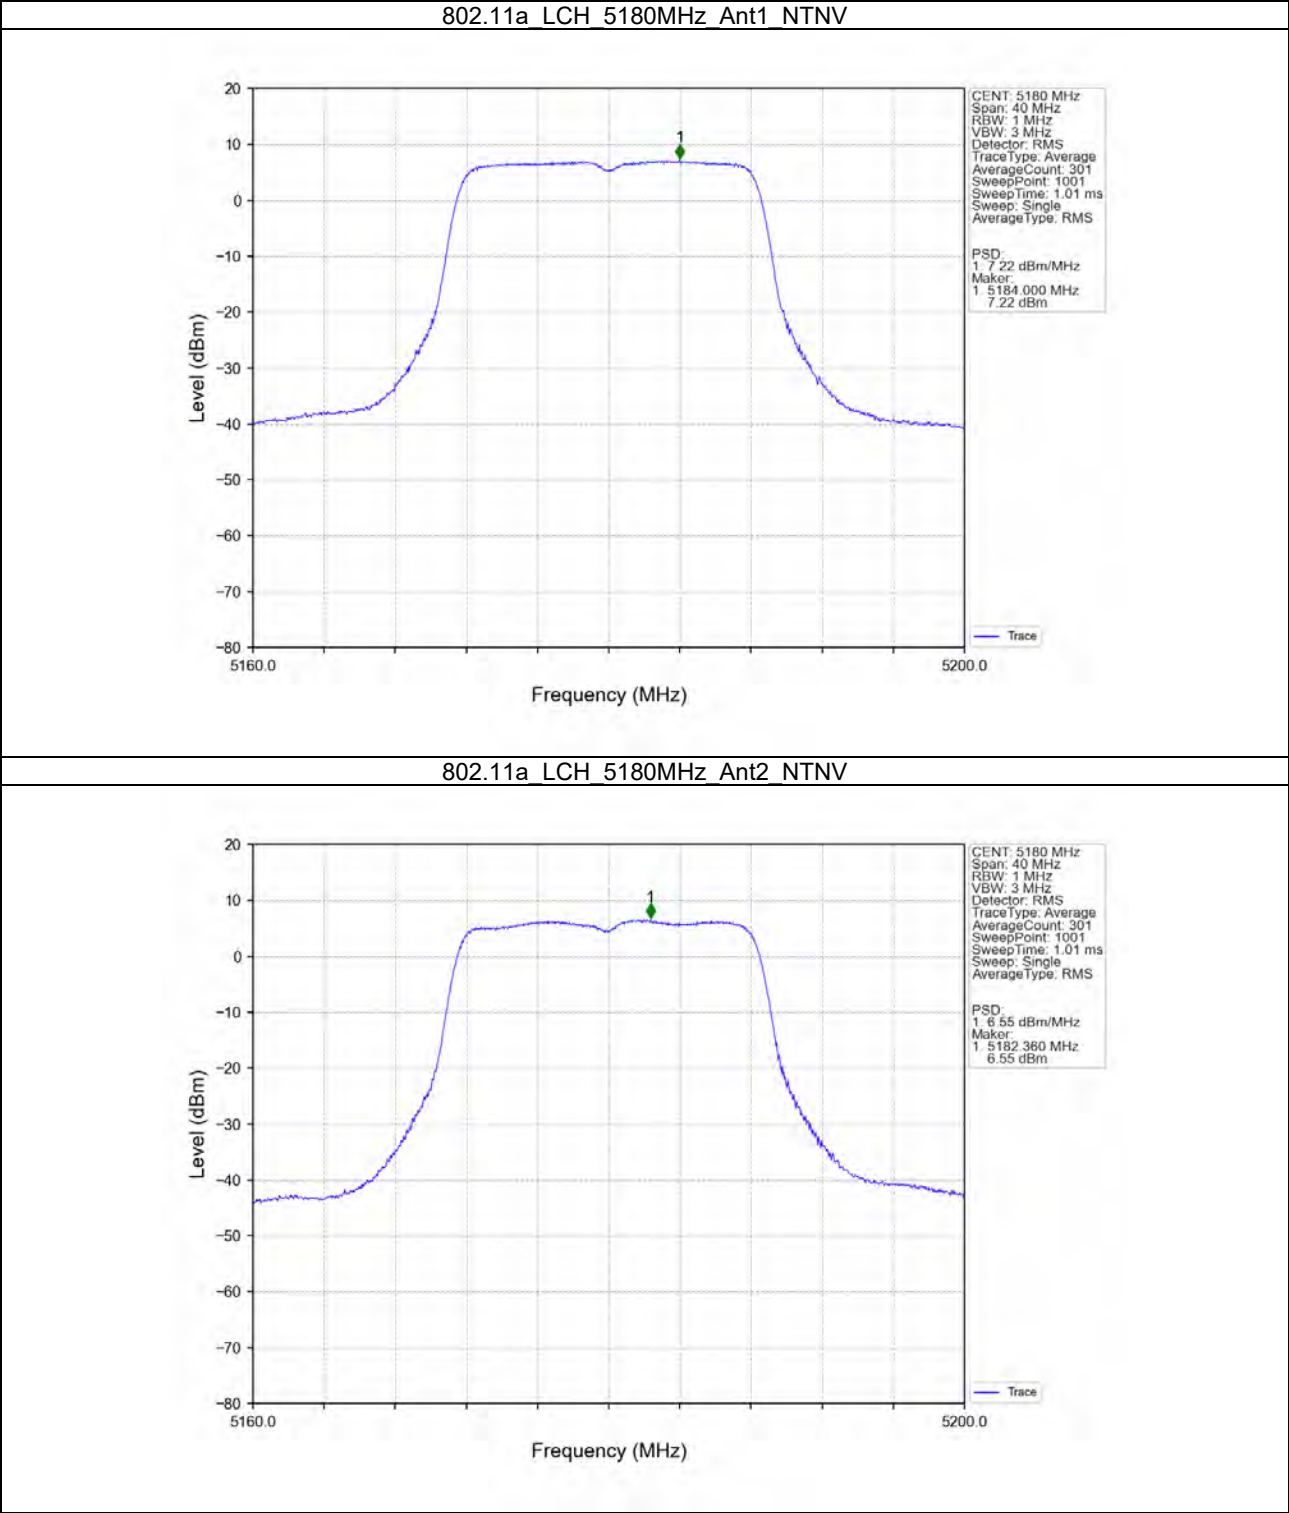



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 328 of 1085

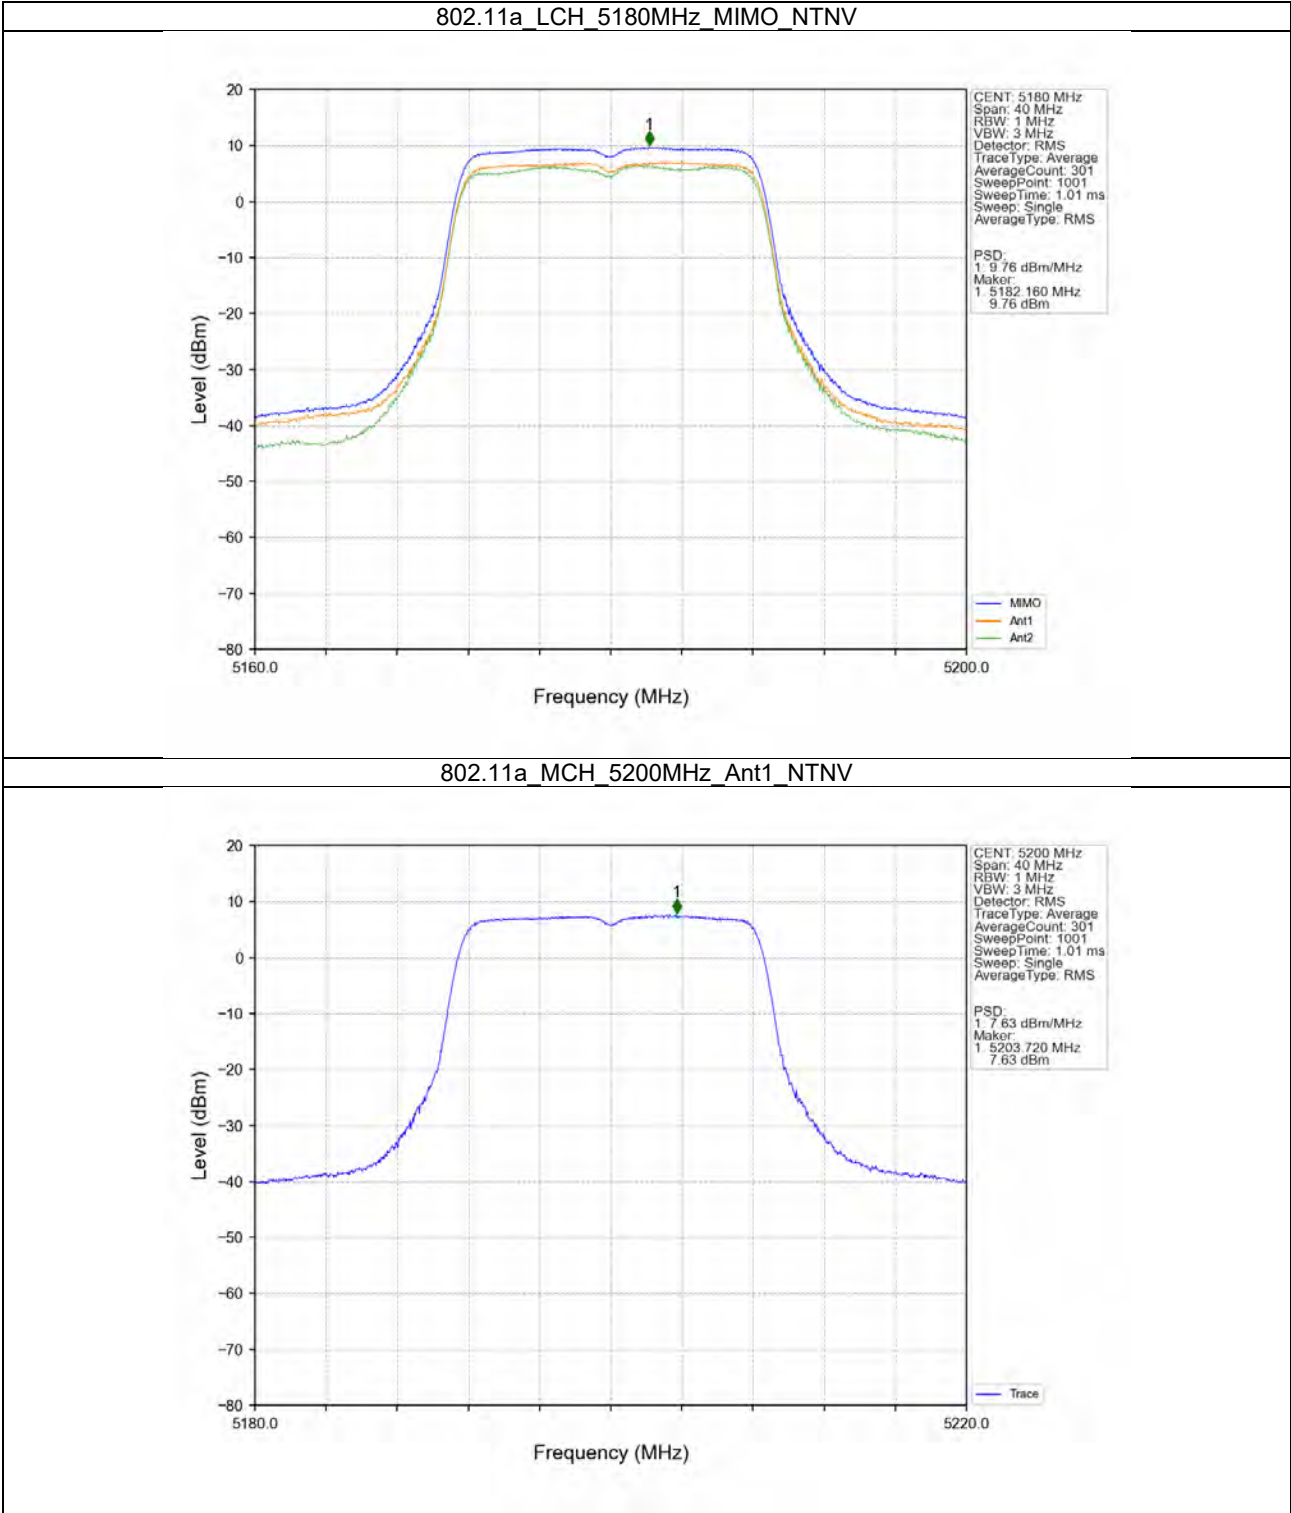



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 329 of 1085

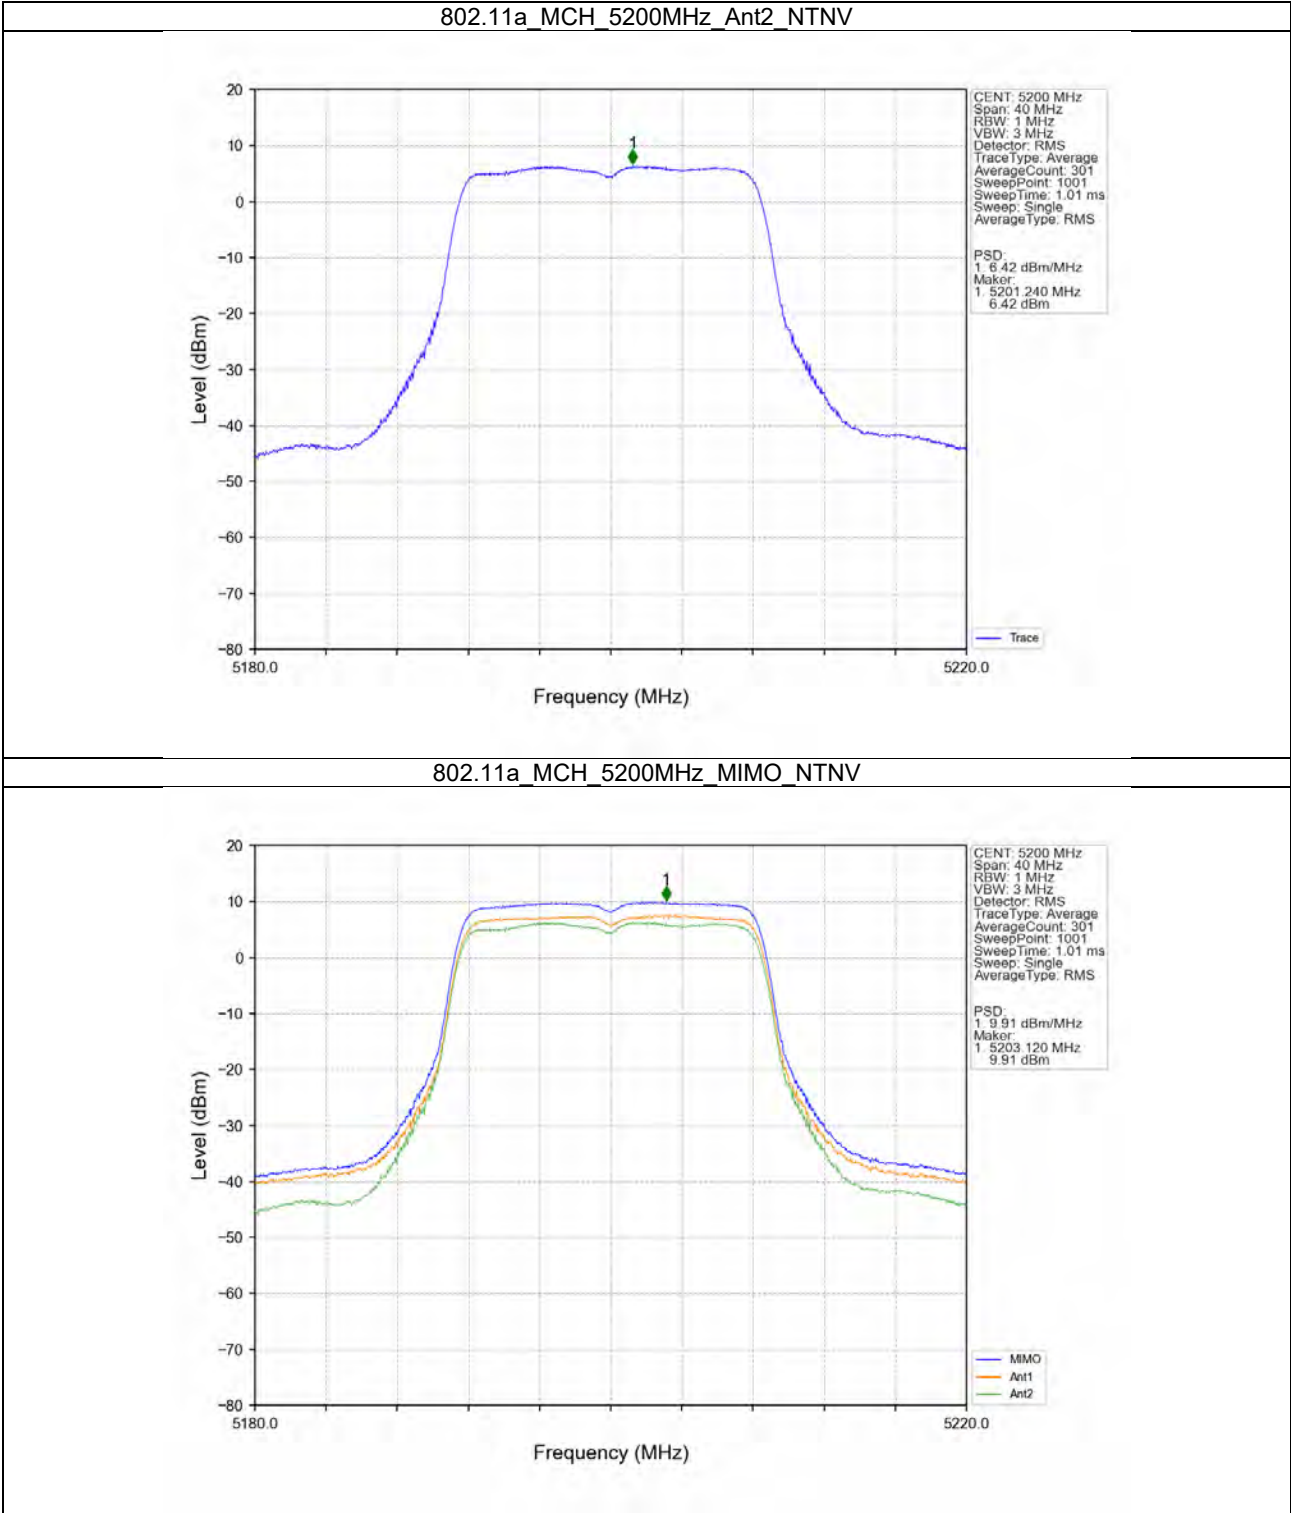



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 330 of 1085

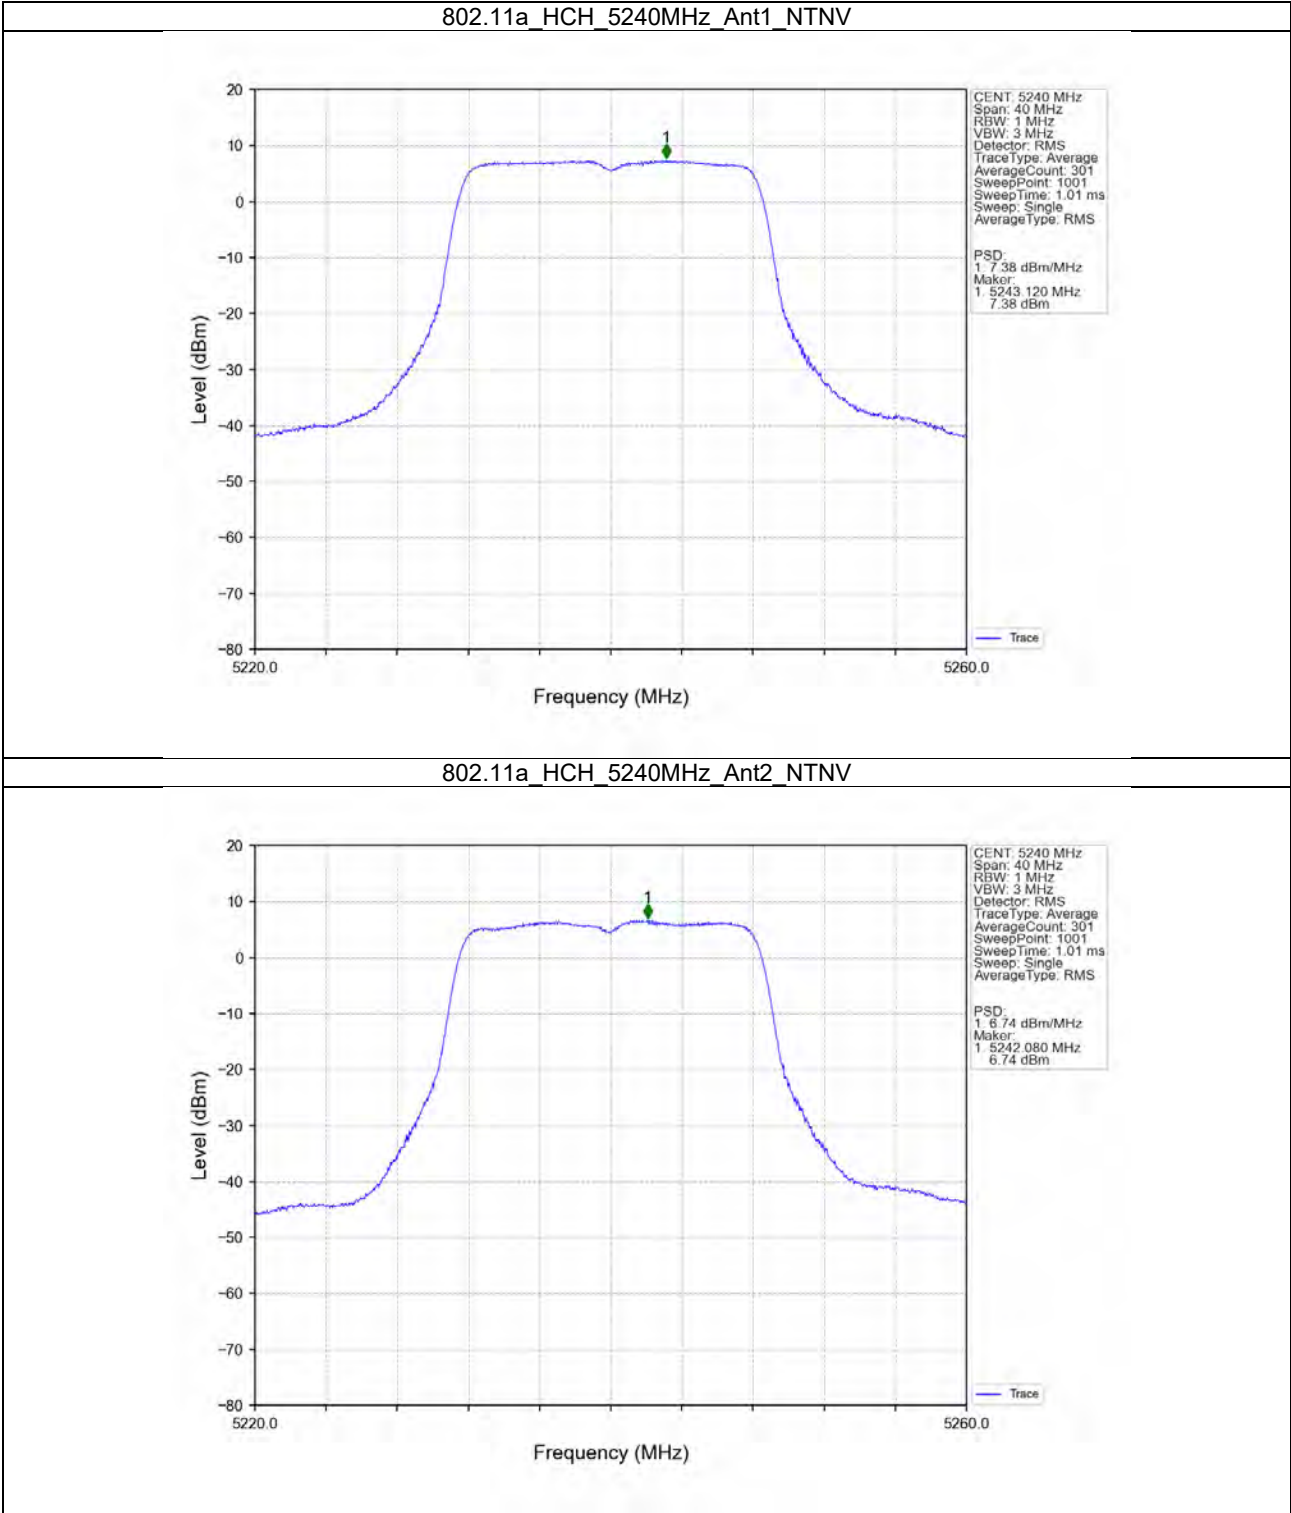



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 331 of 1085

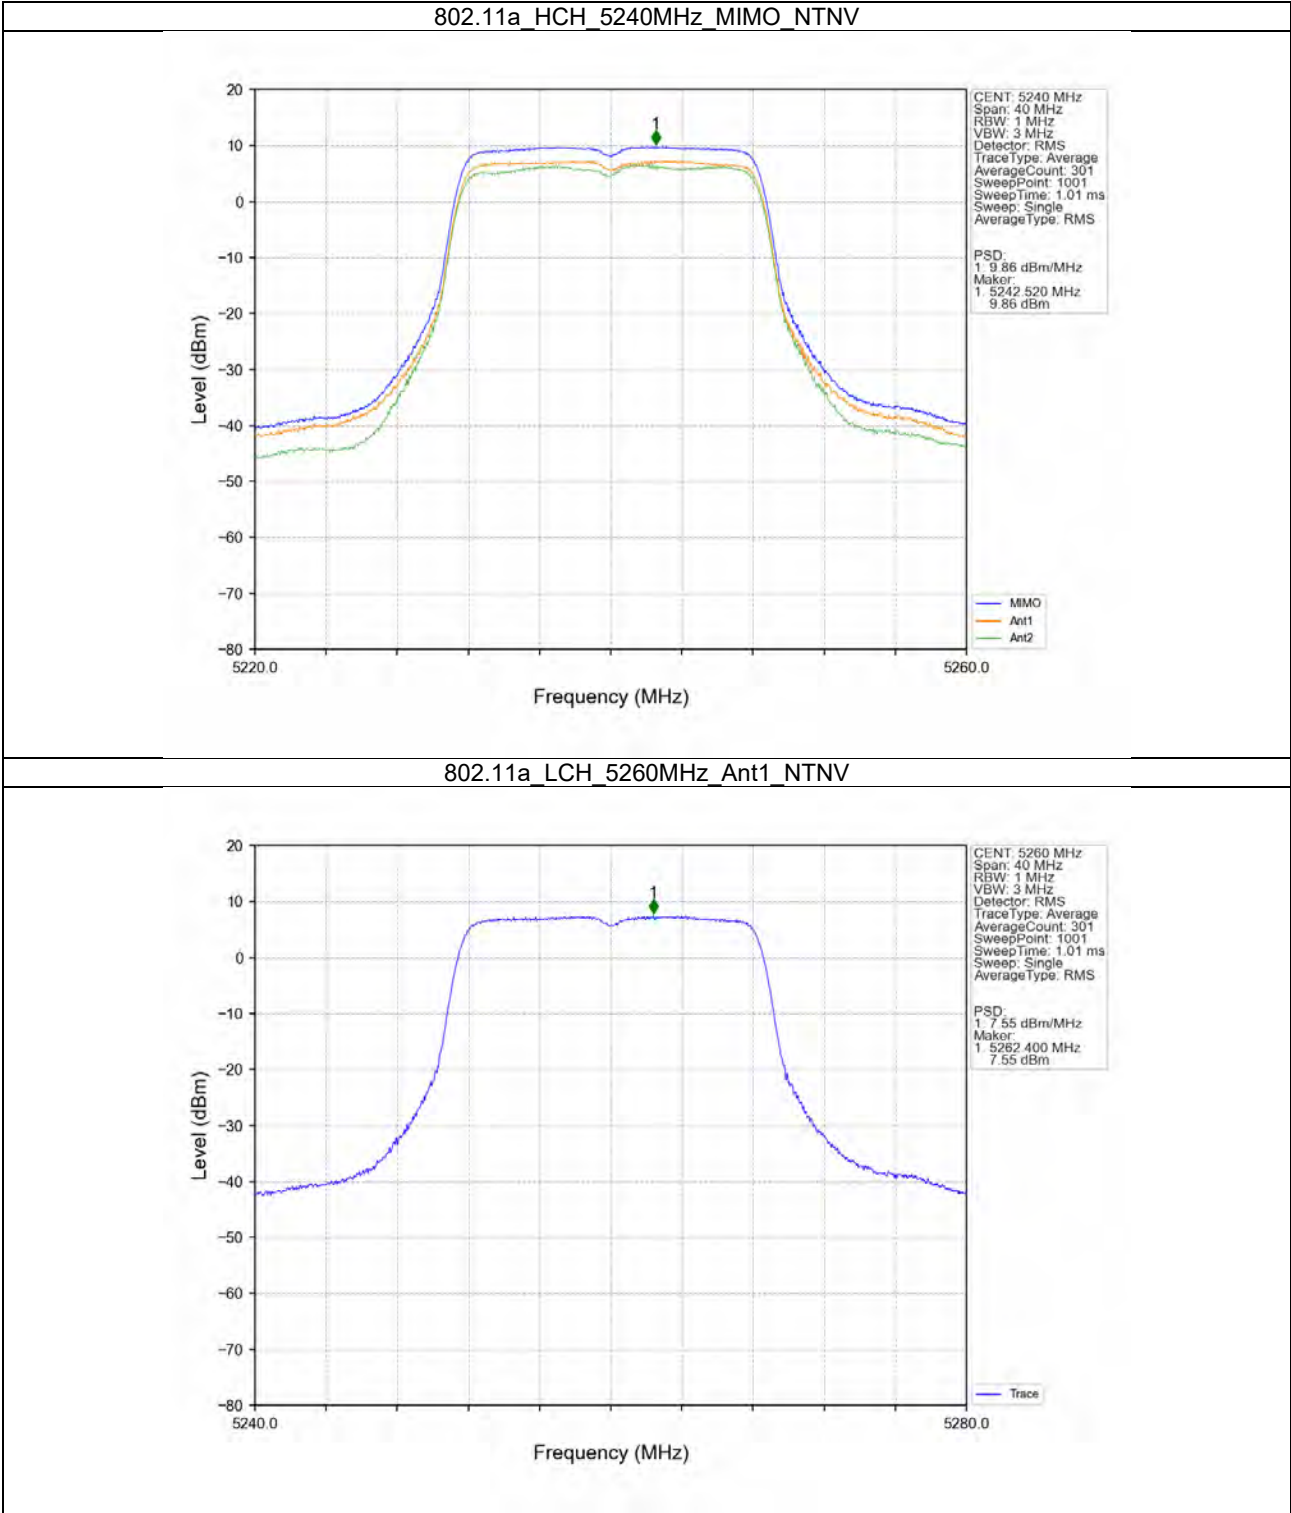



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 332 of 1085

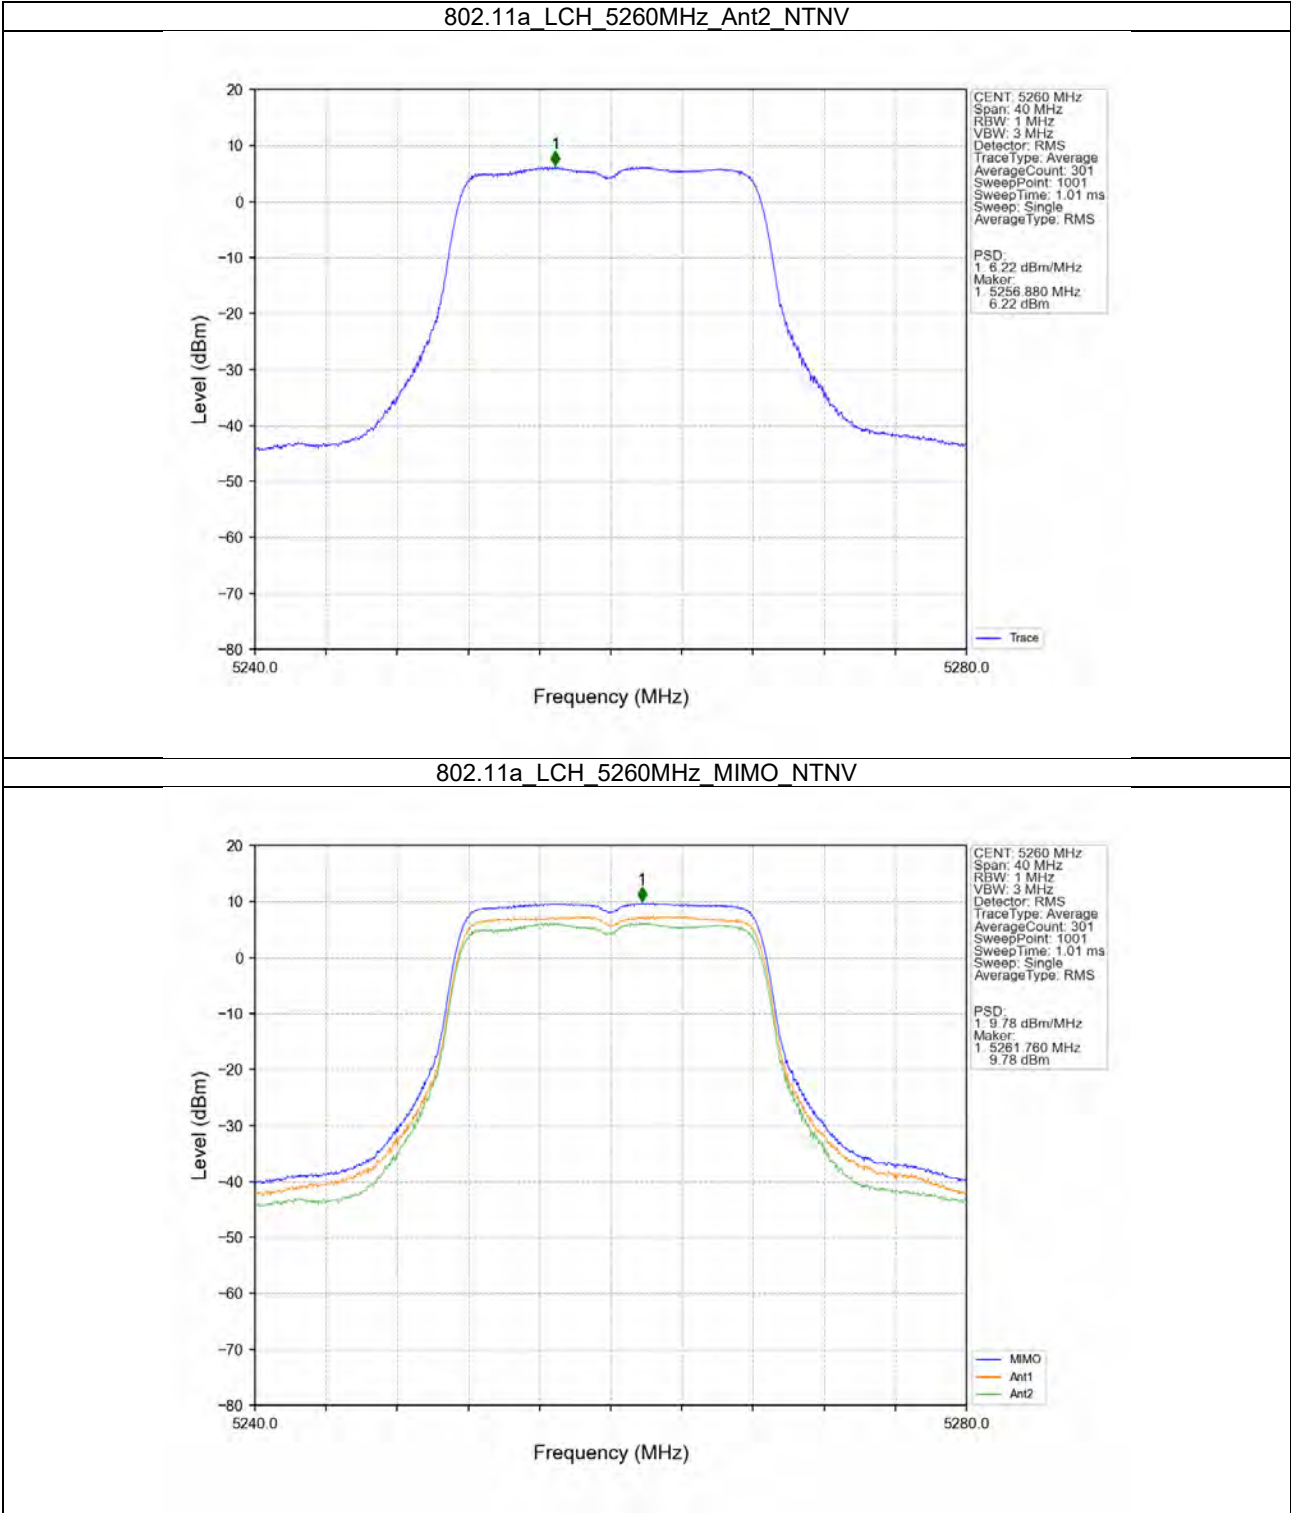



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 333 of 1085

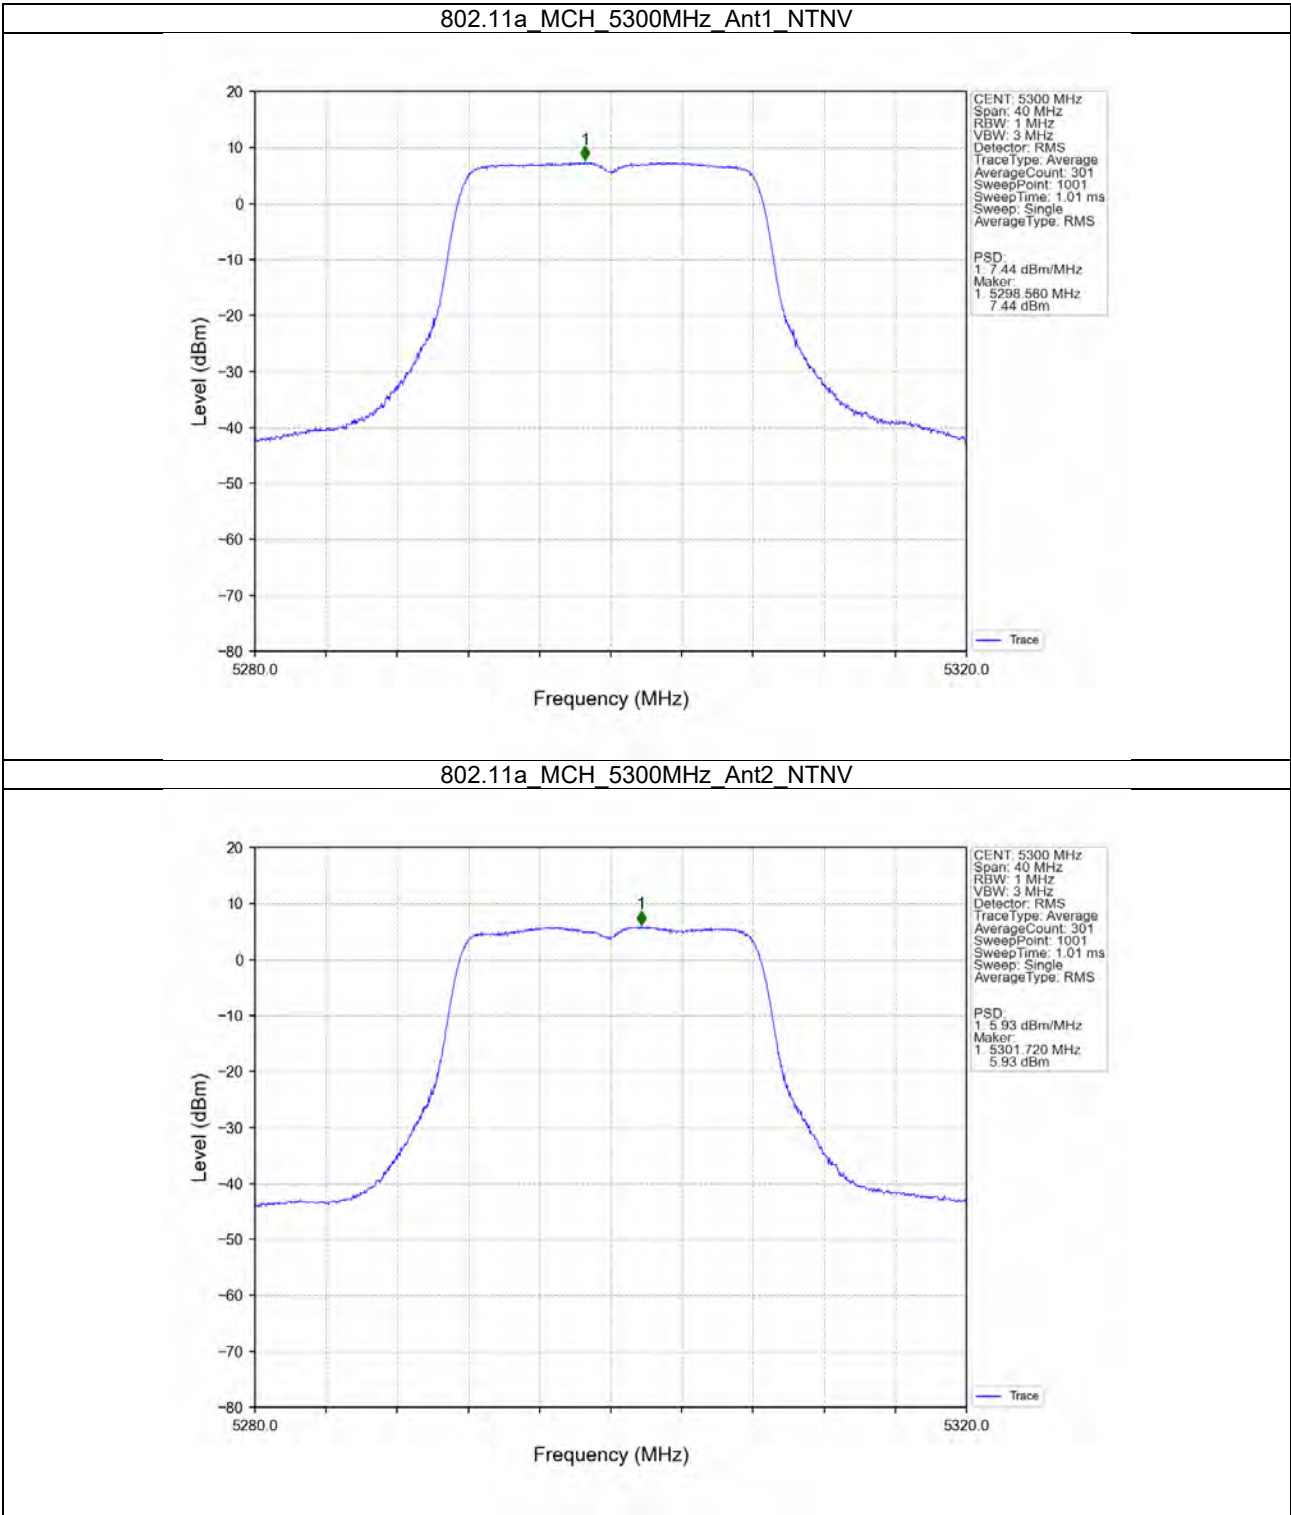



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 334 of 1085

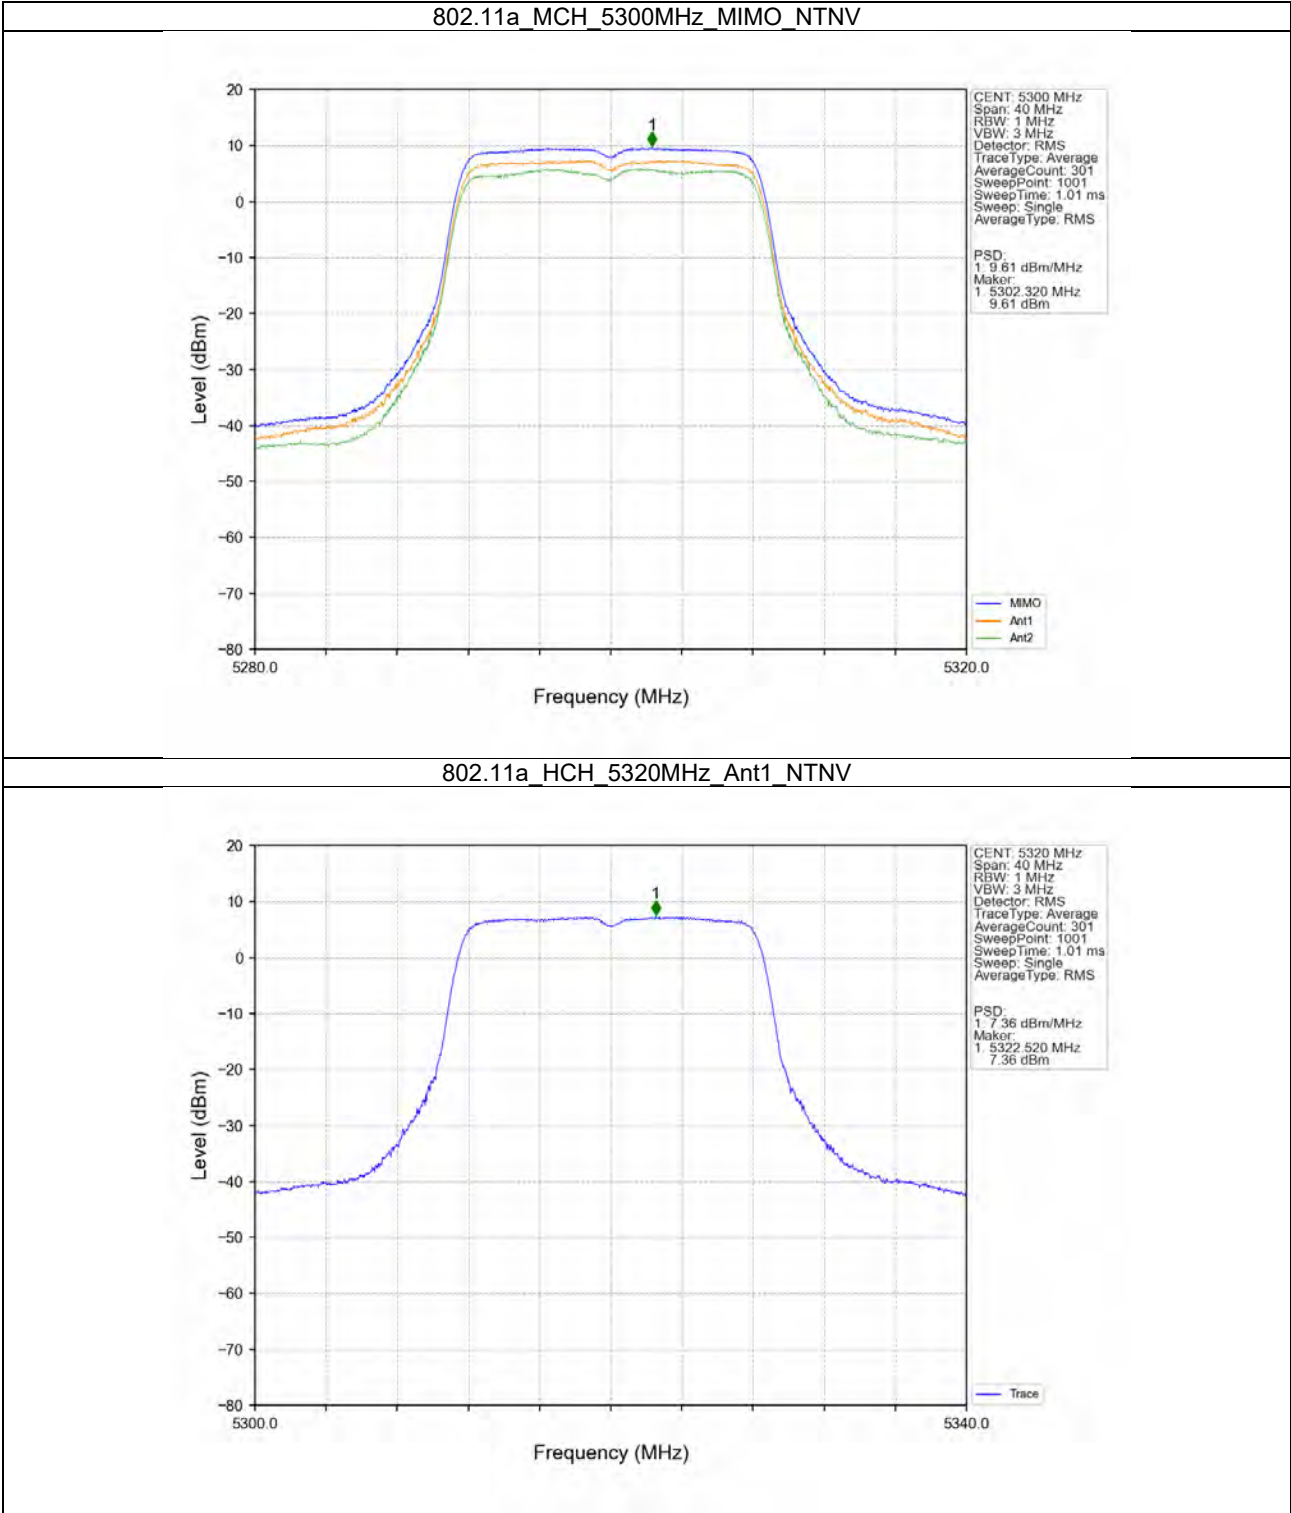



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 335 of 1085

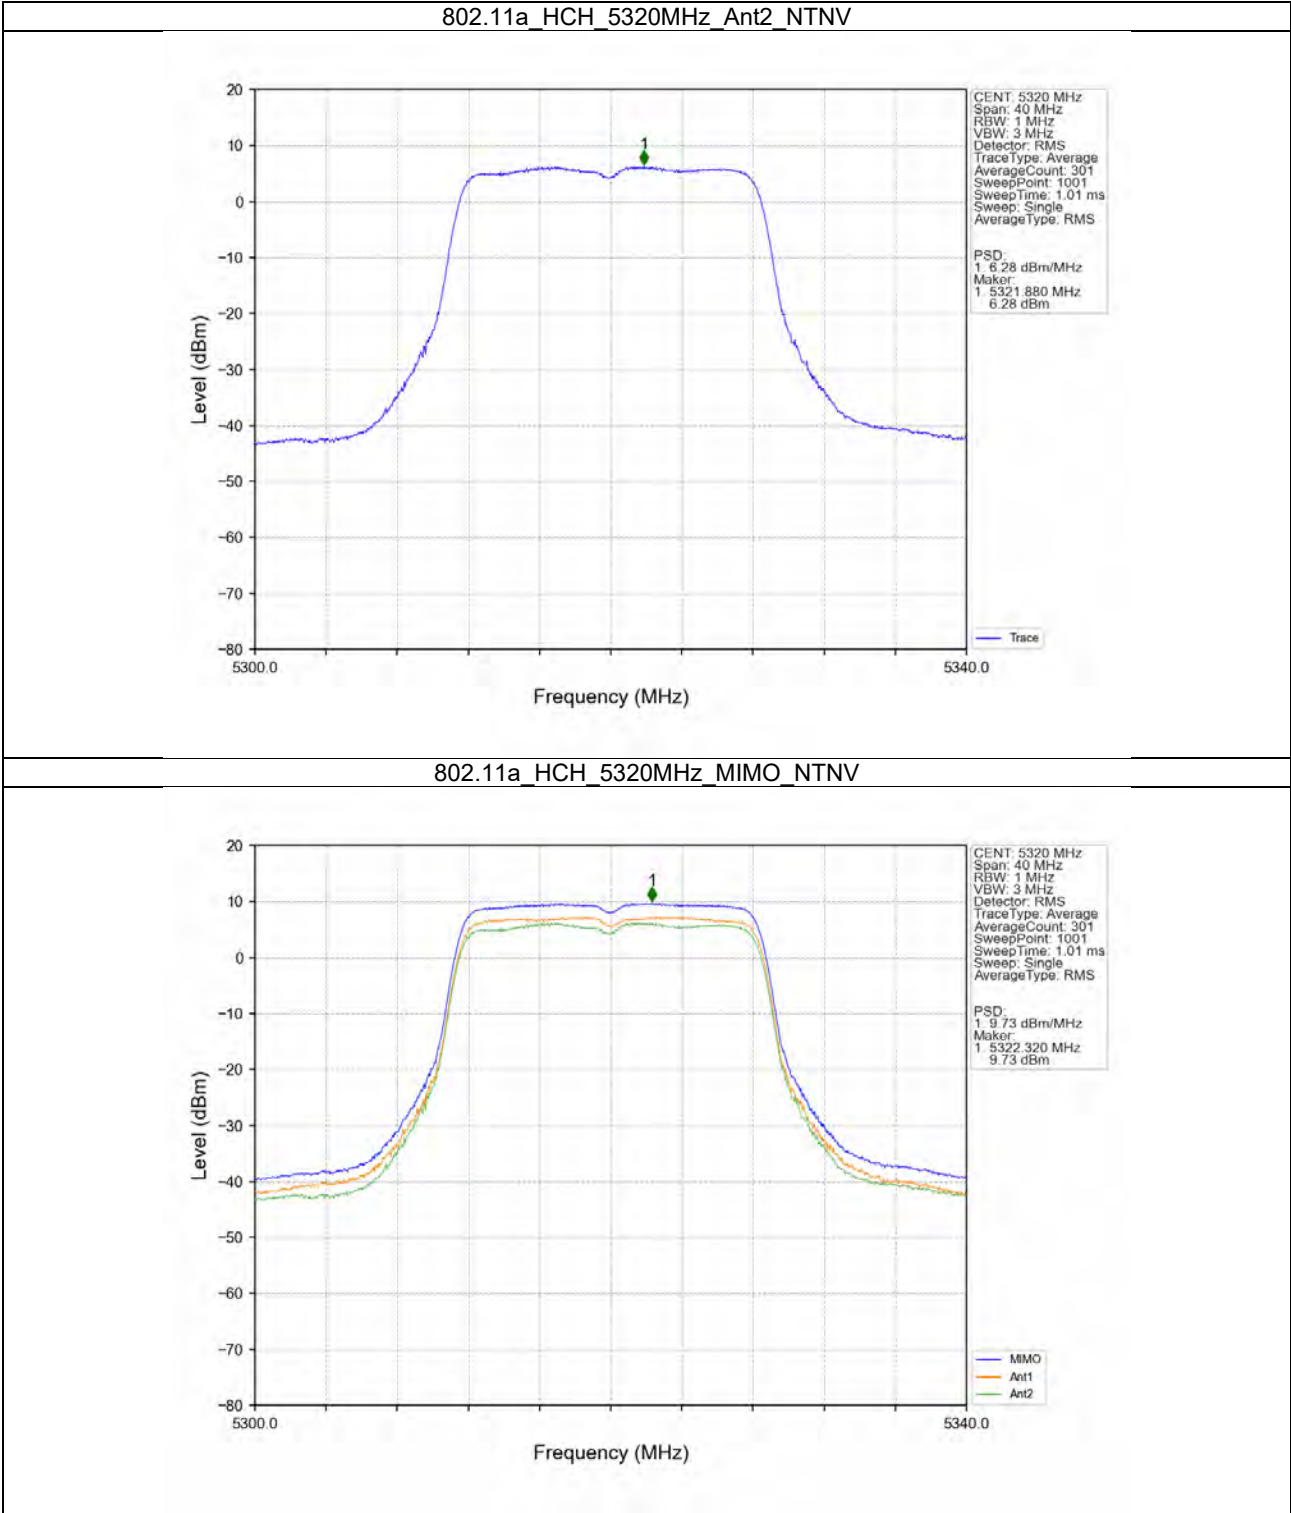



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 336 of 1085

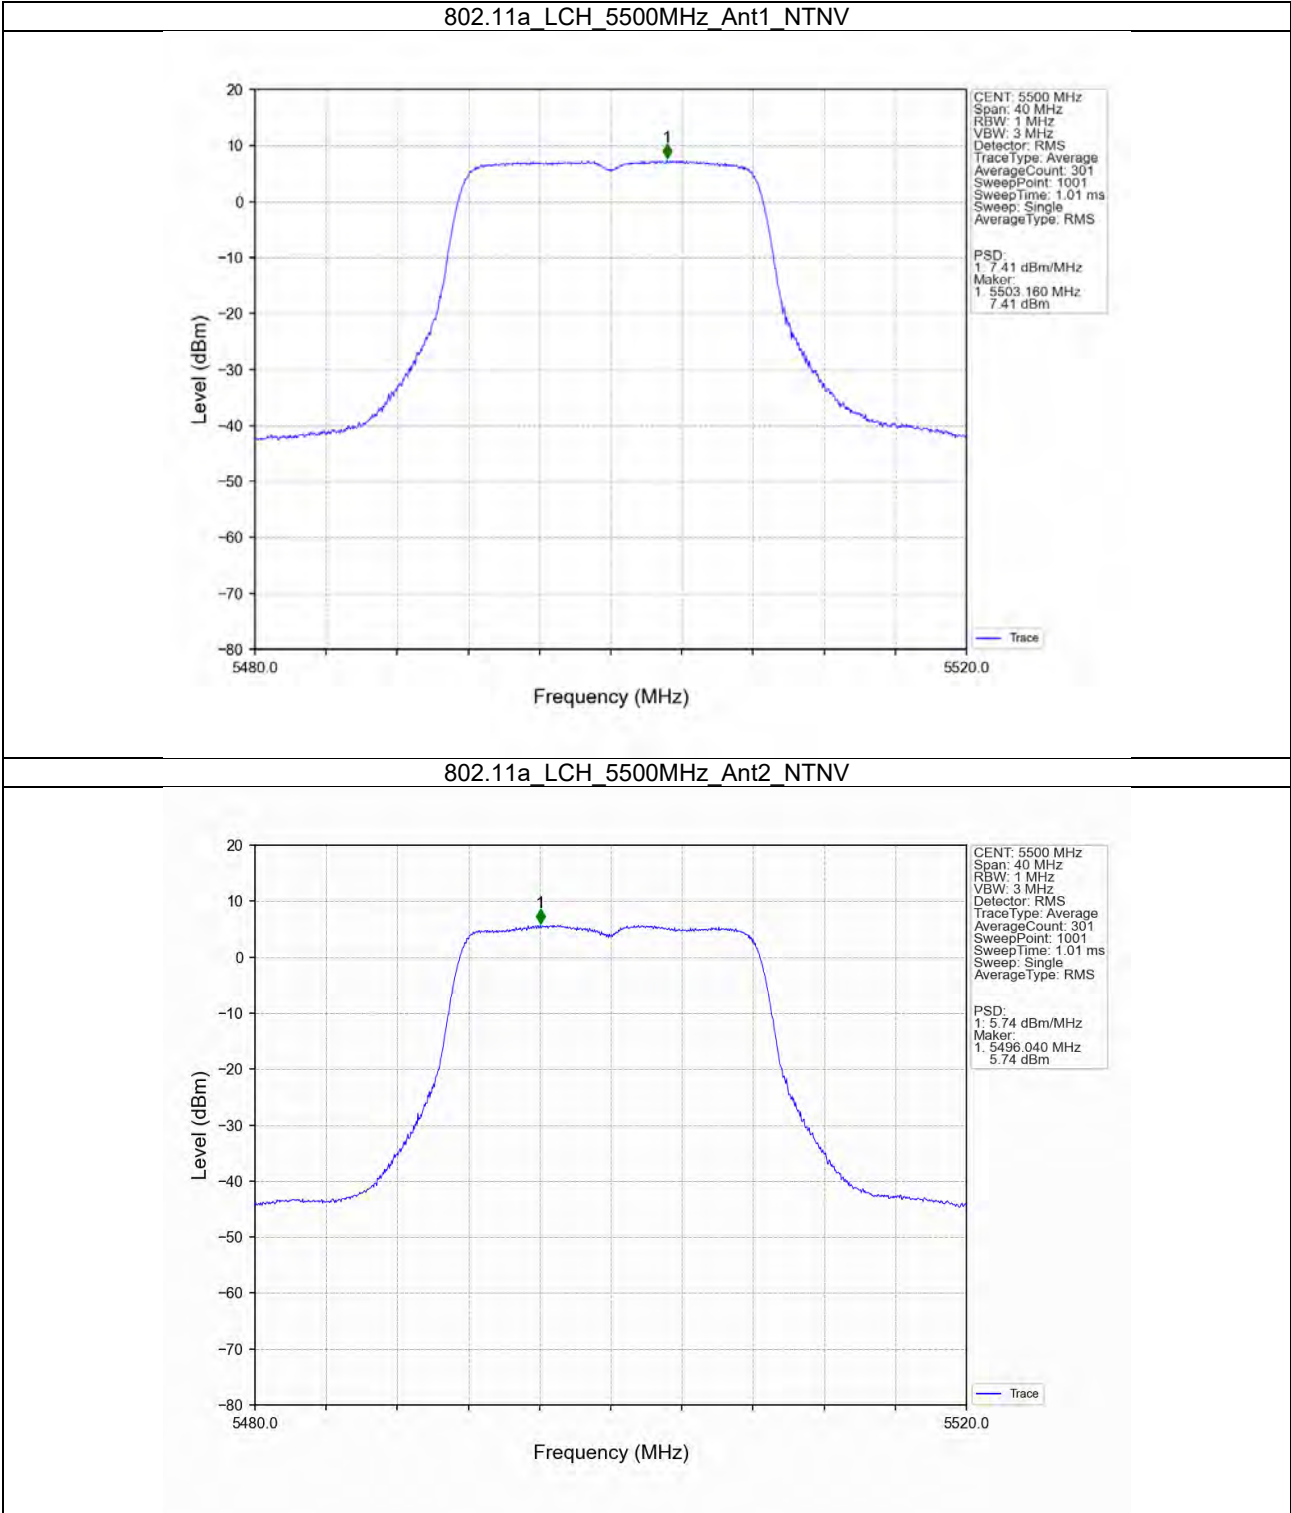



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 337 of 1085

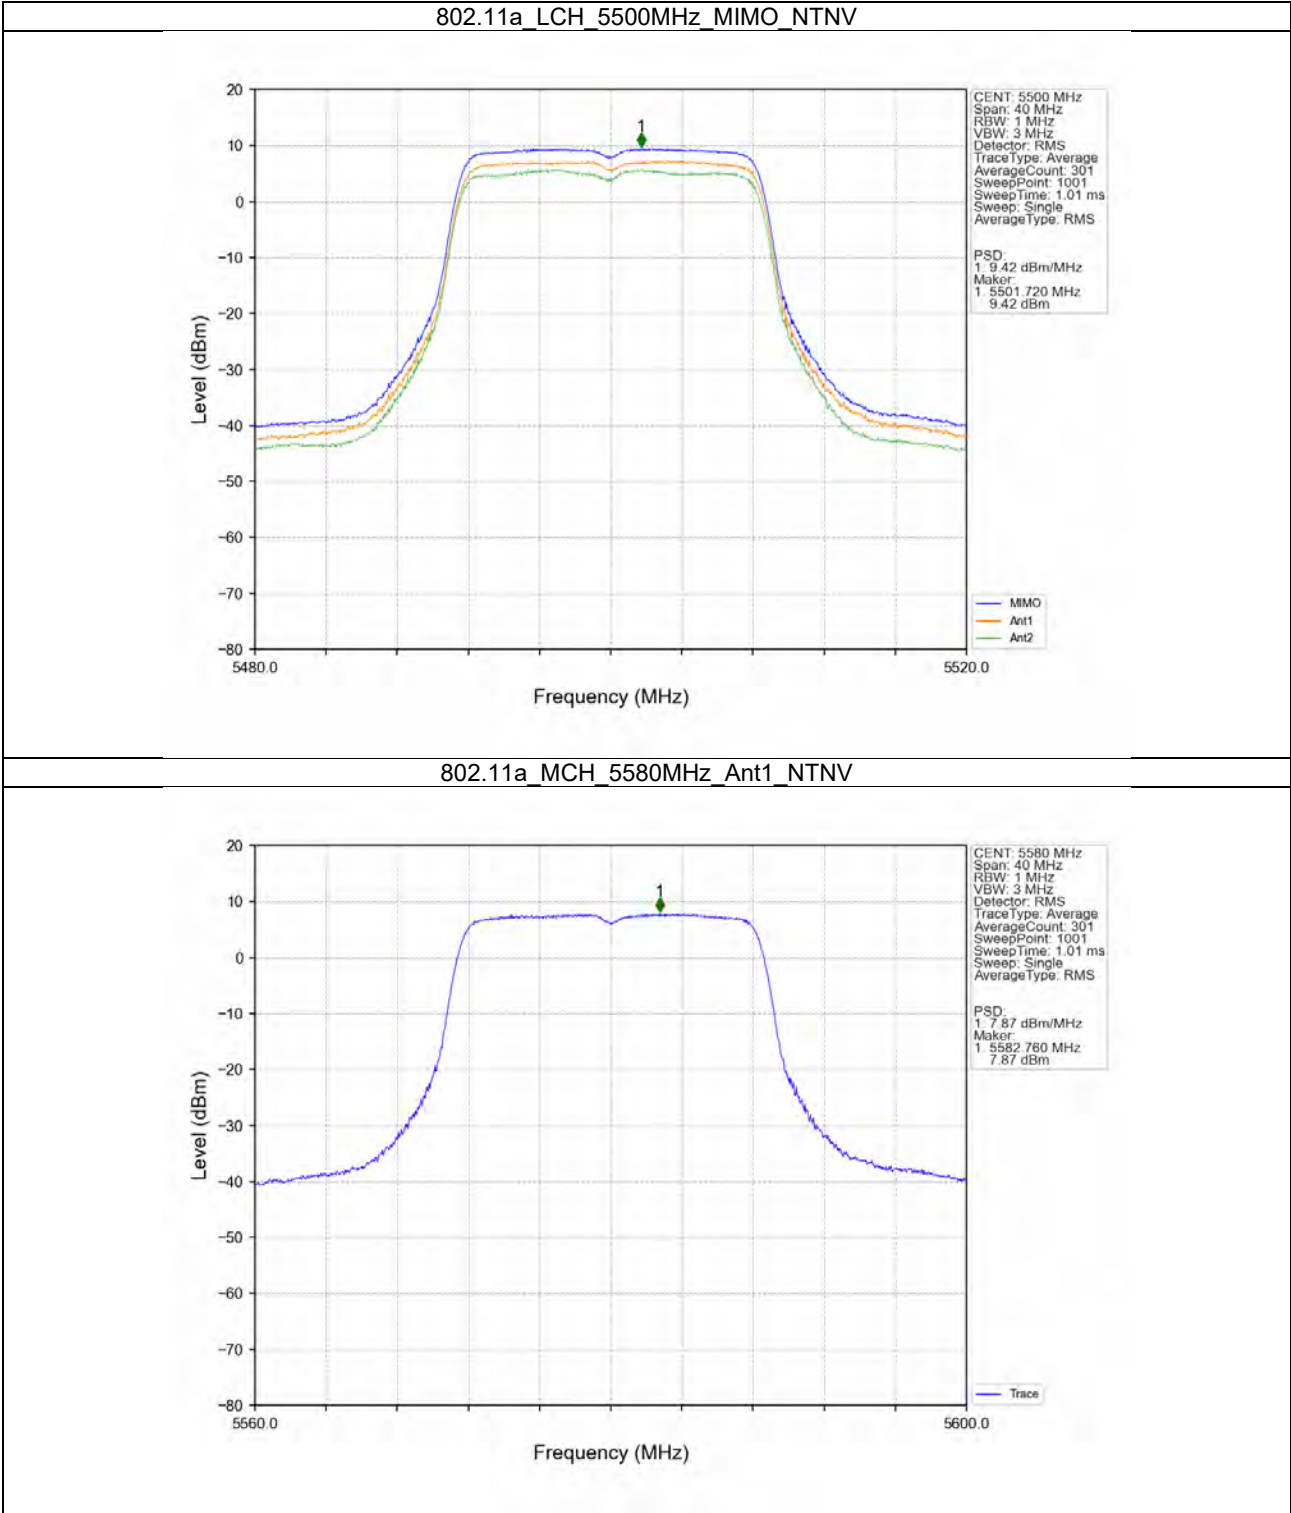



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 338 of 1085

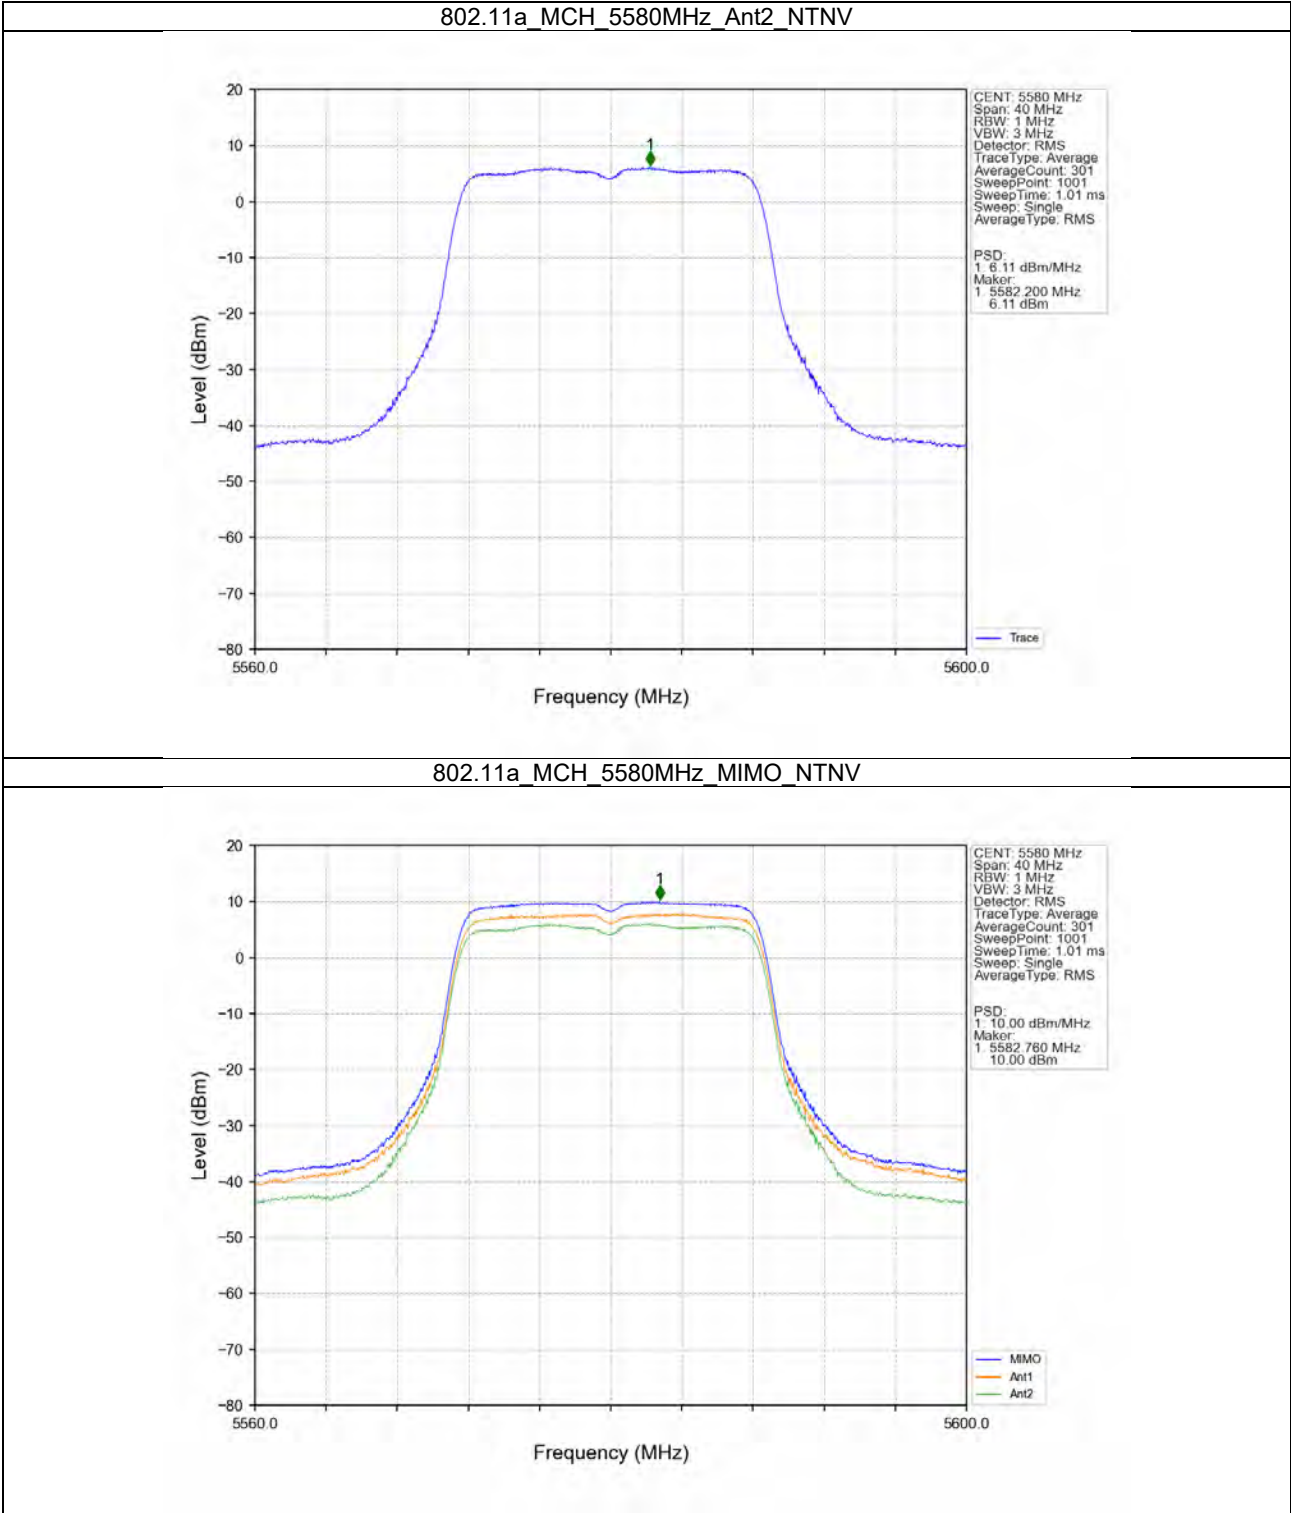



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 339 of 1085

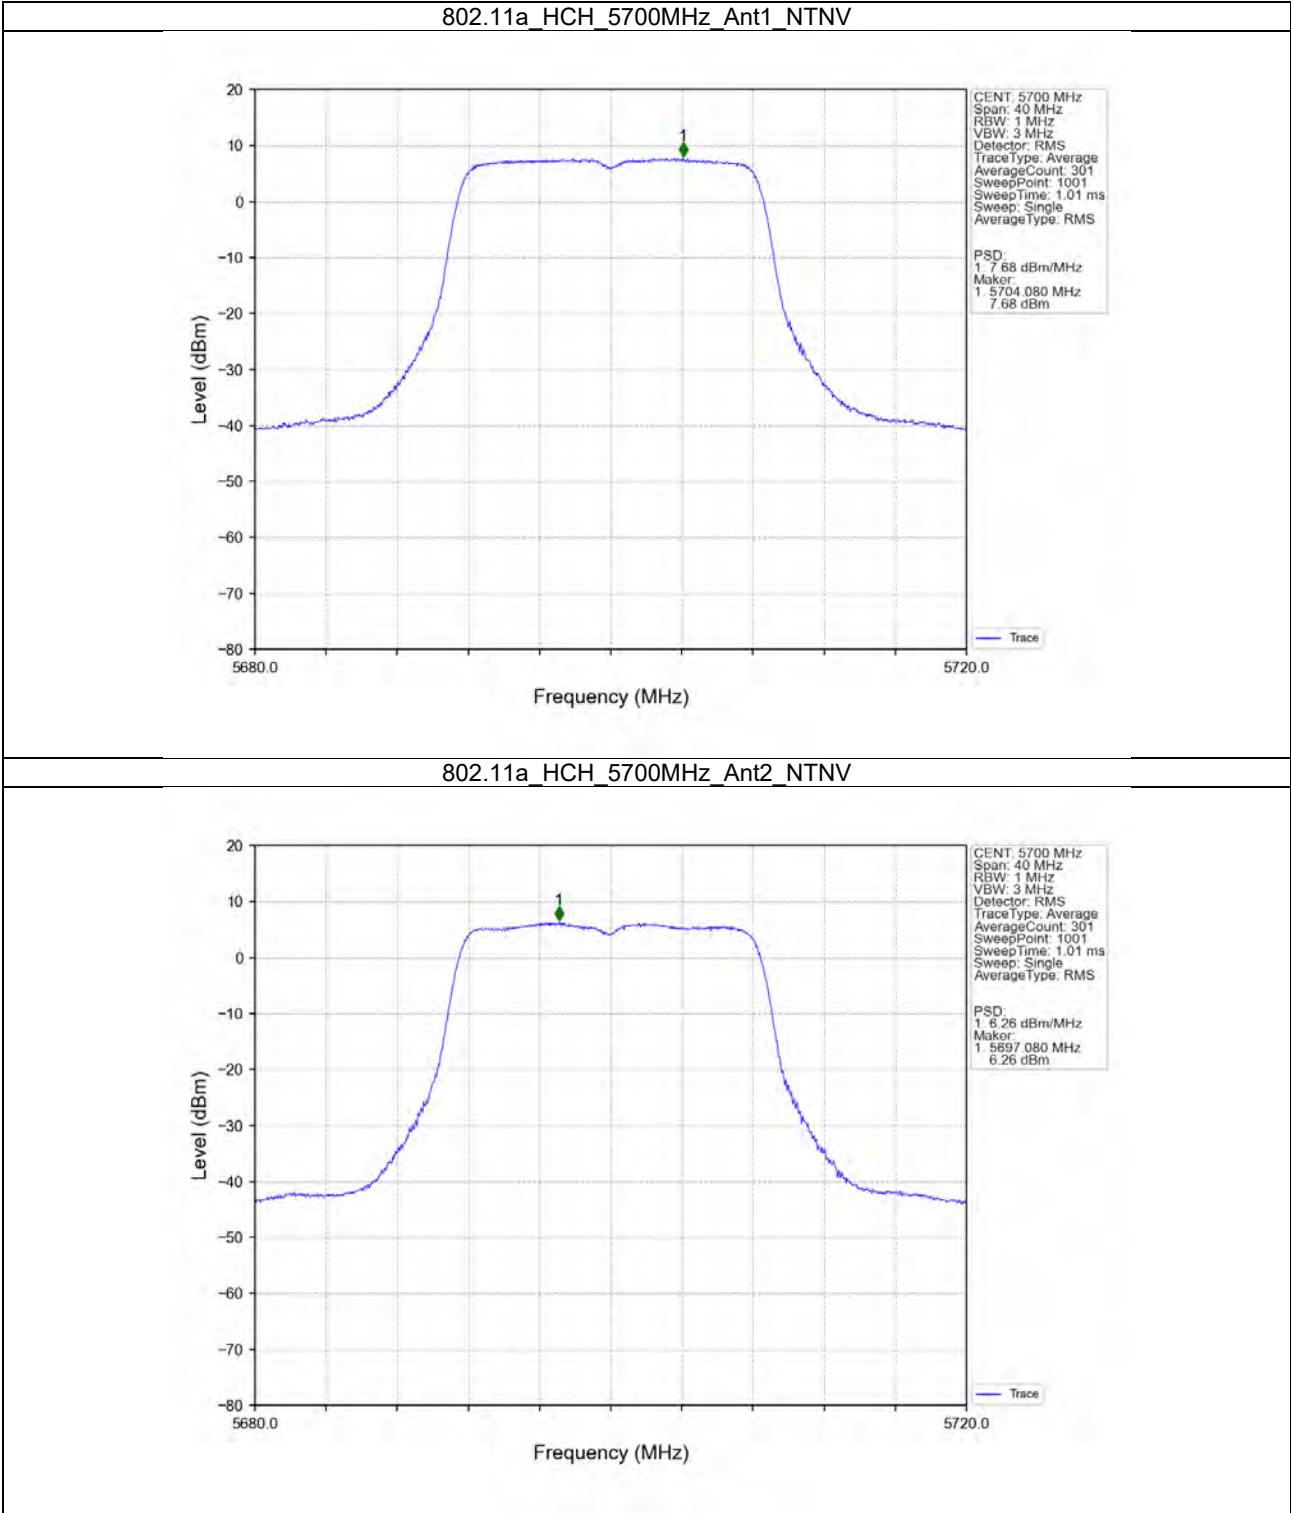



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 340 of 1085

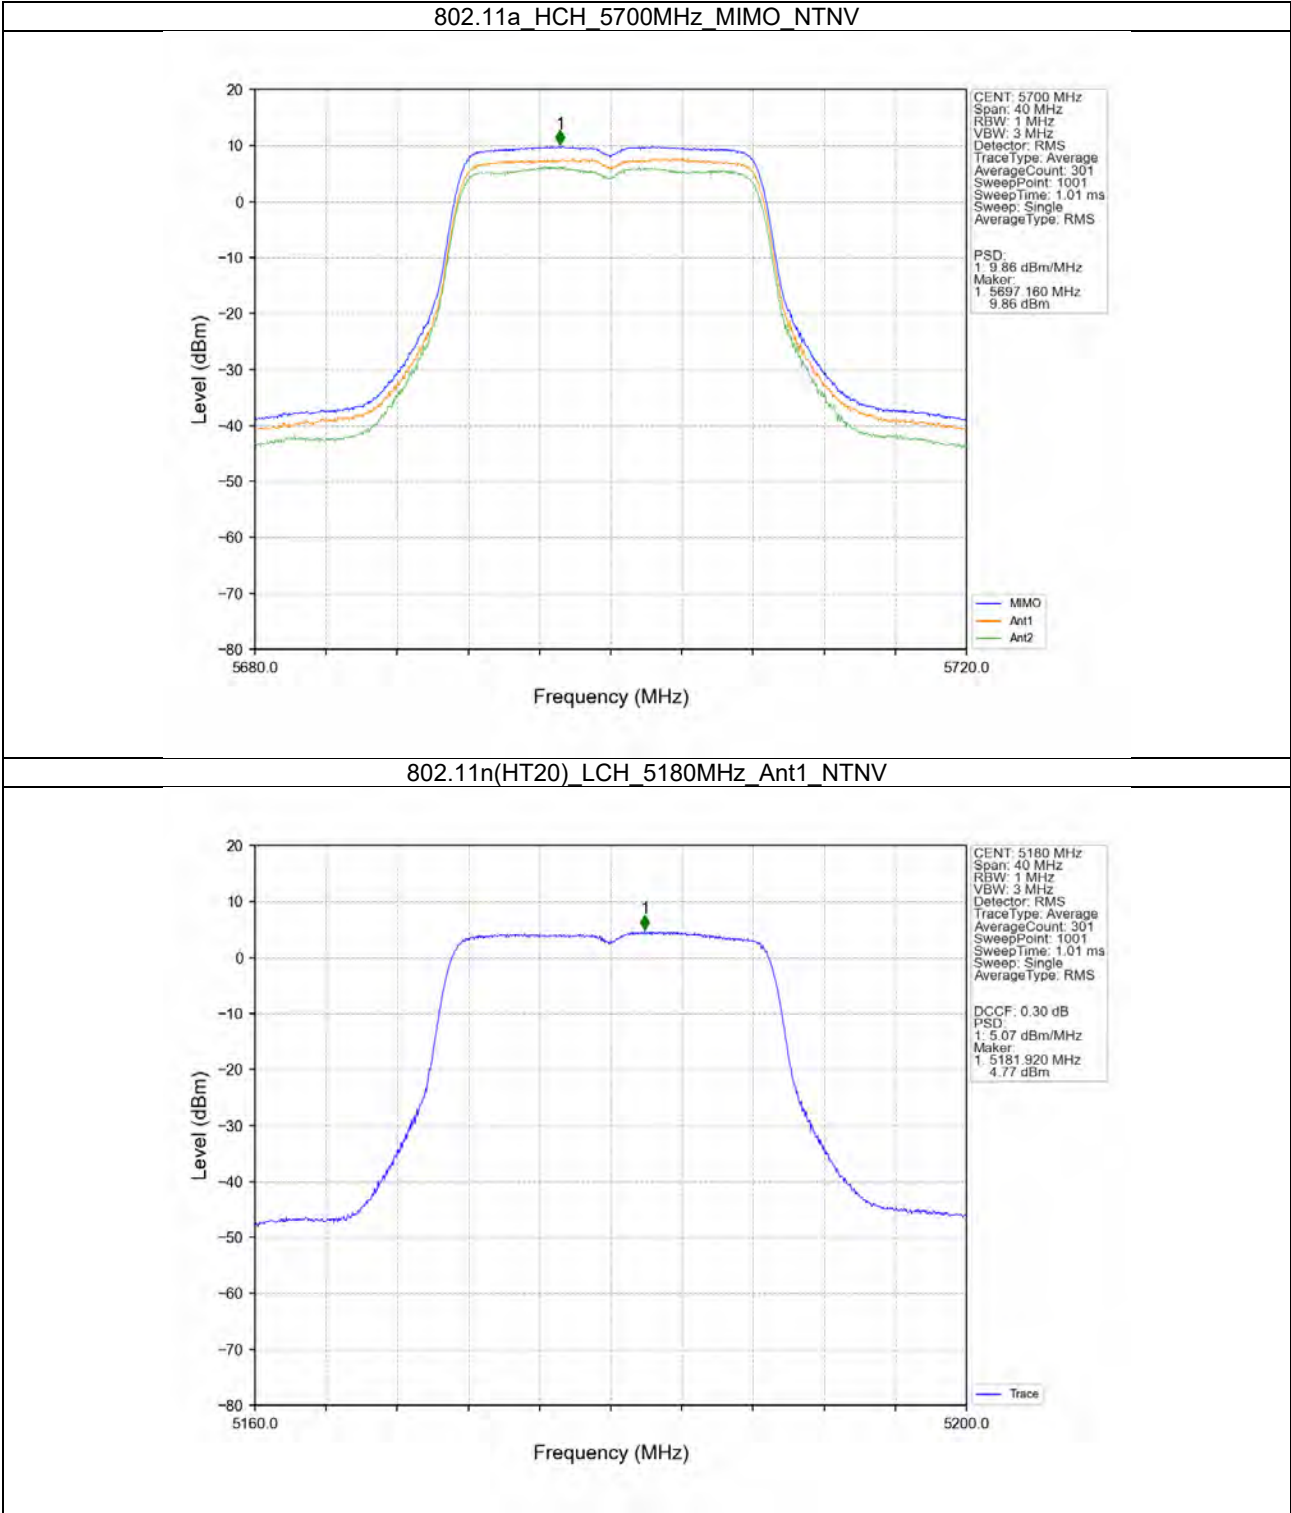



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 341 of 1085

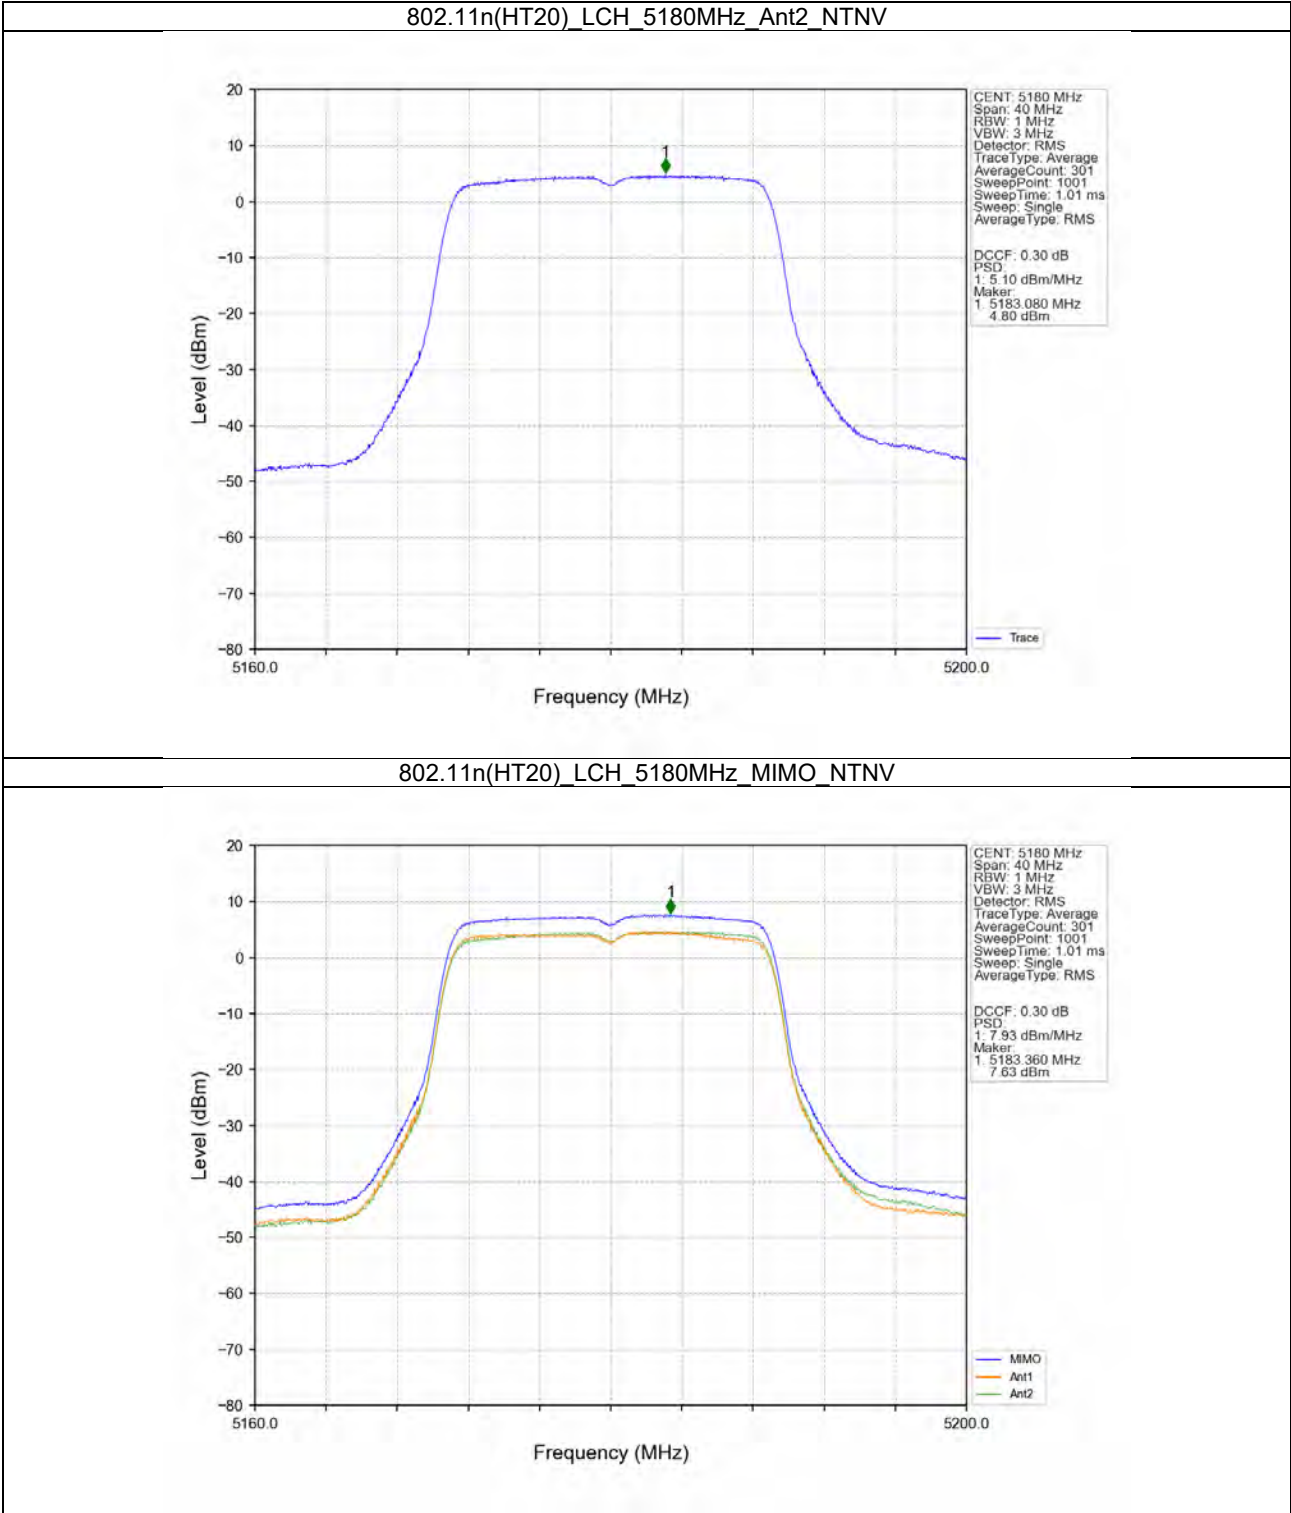



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 342 of 1085

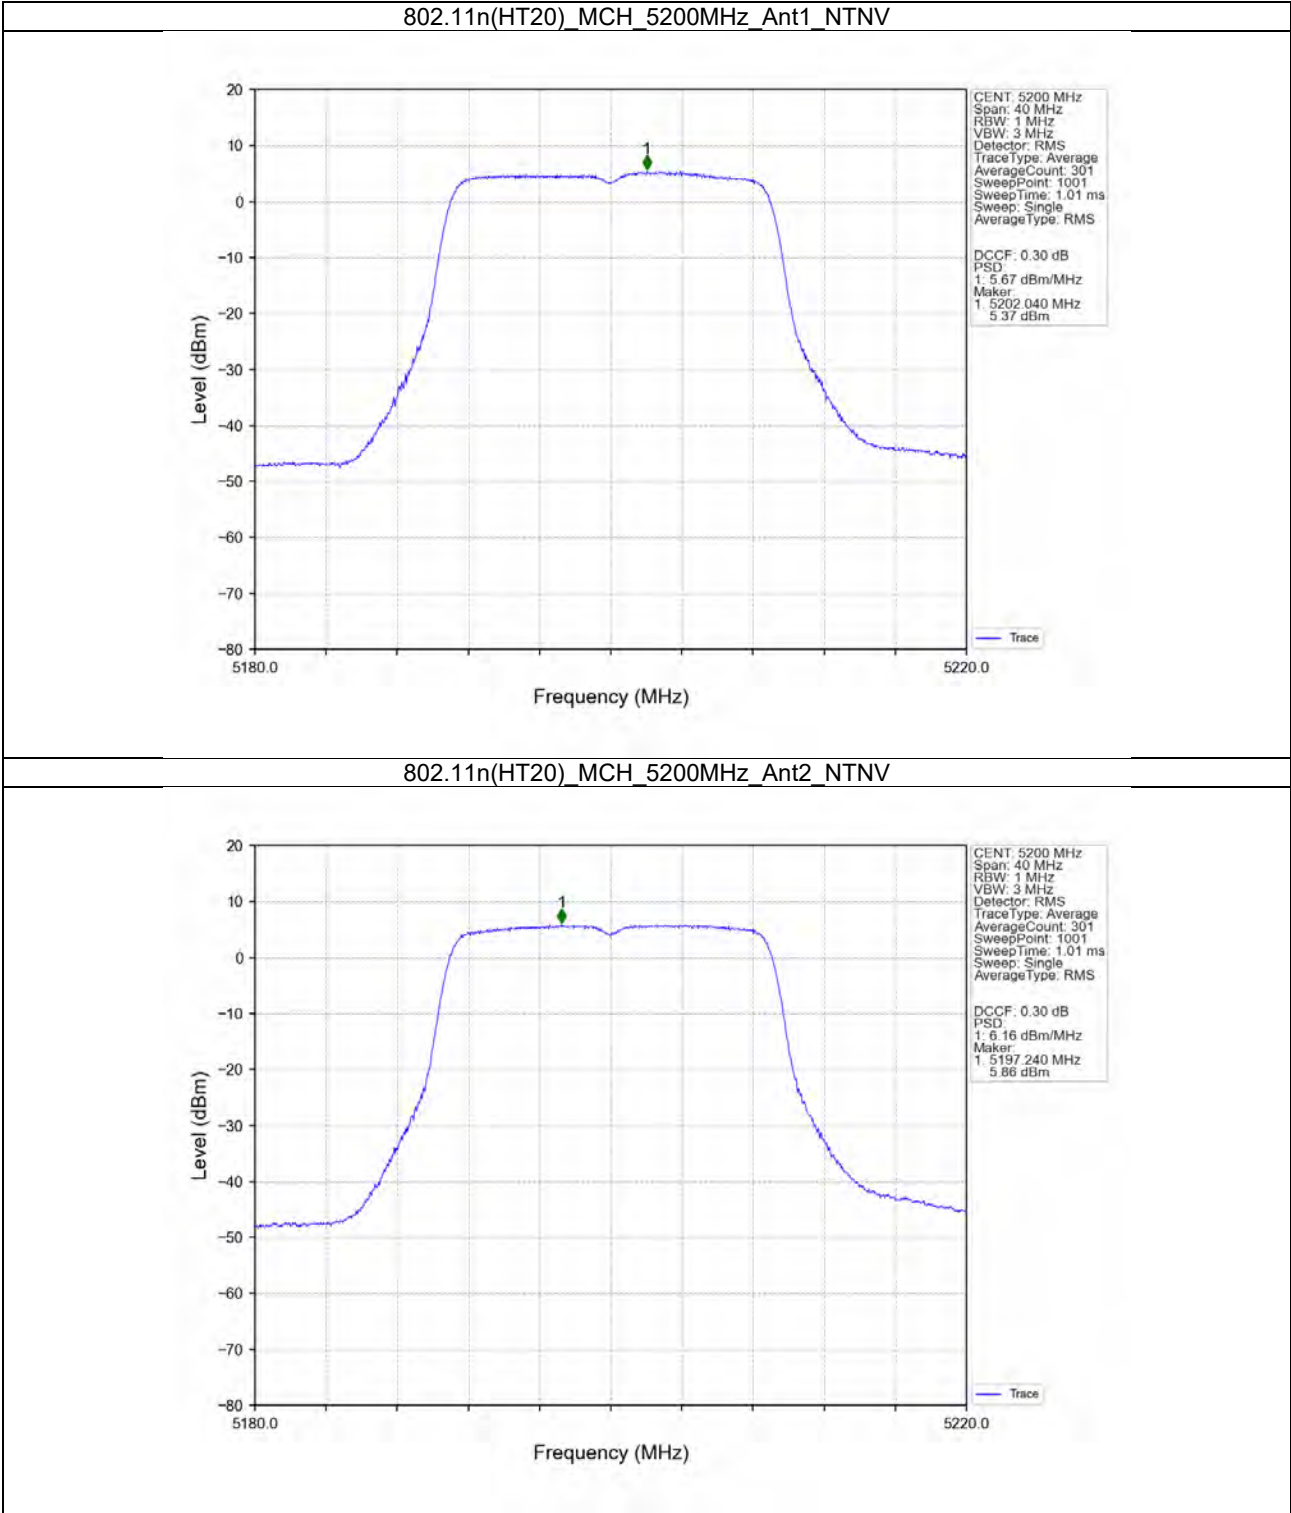



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 343 of 1085

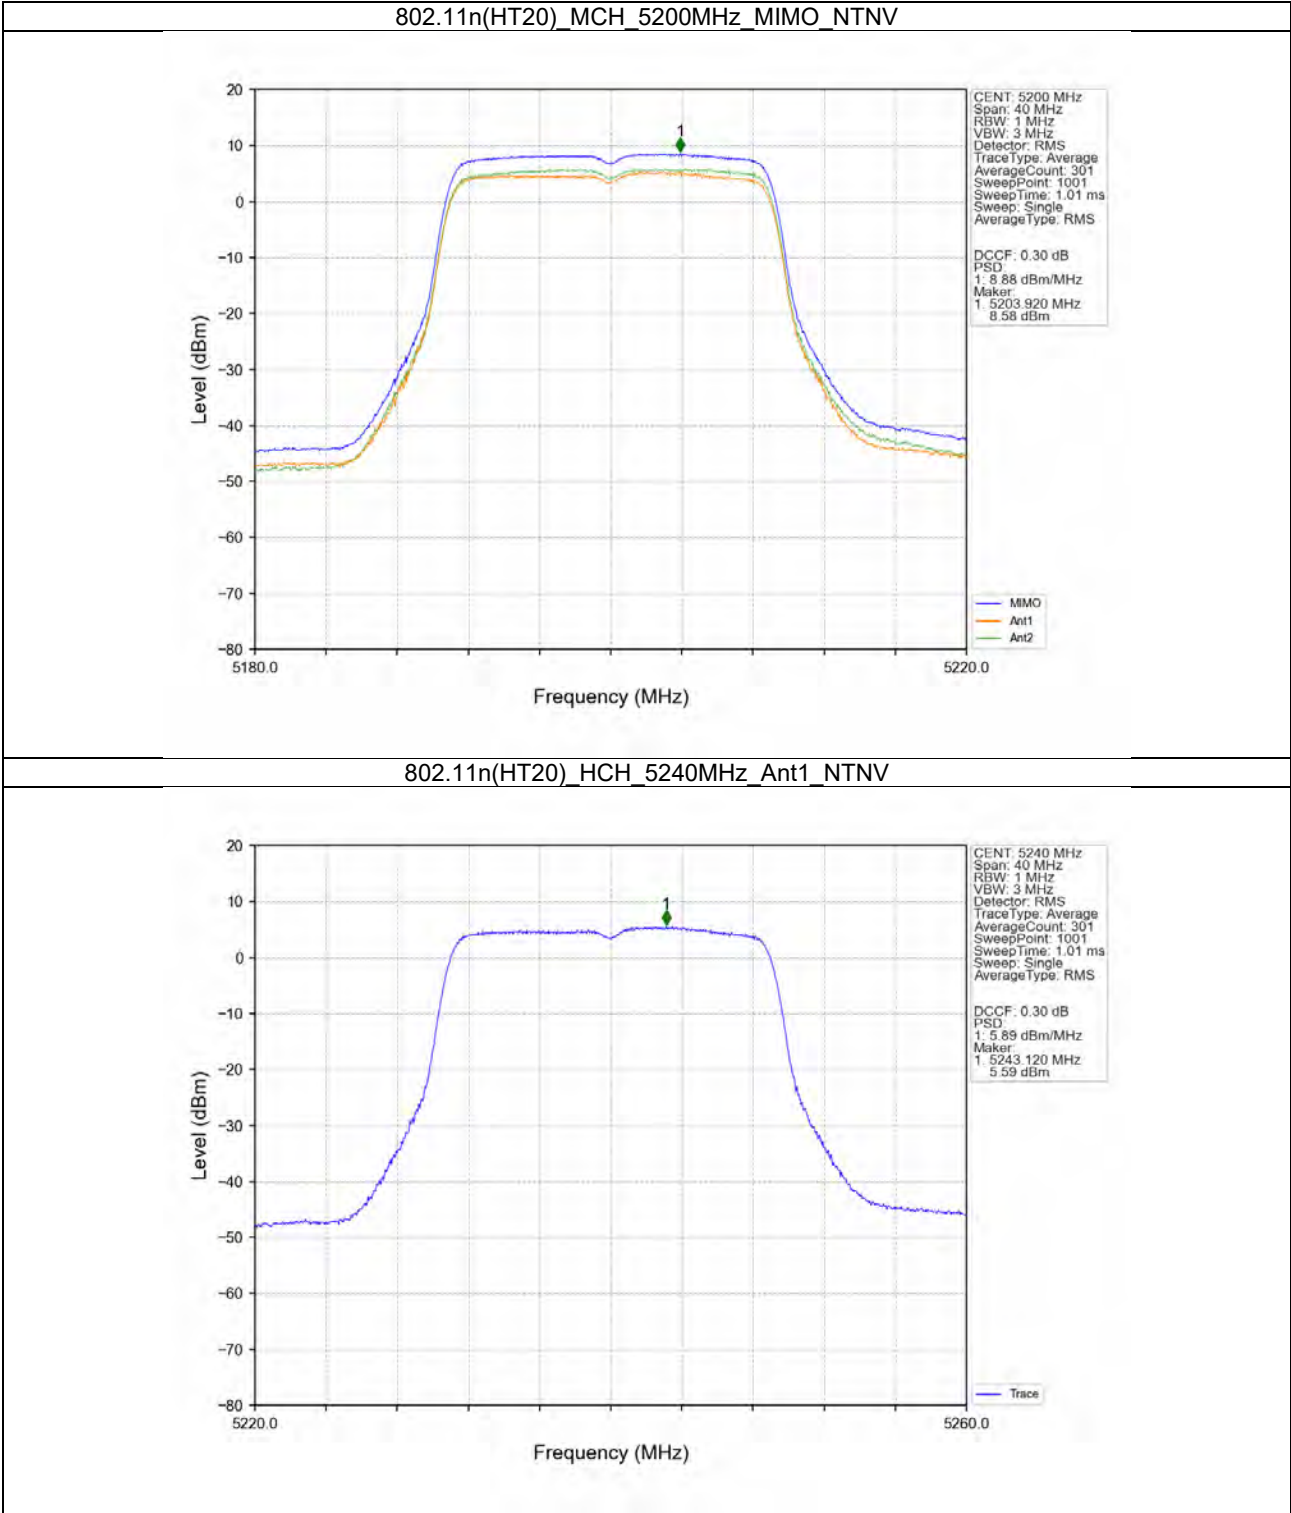



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.

Report No.: SUCR250300017004
Rev.: 01
Page: 344 of 1085

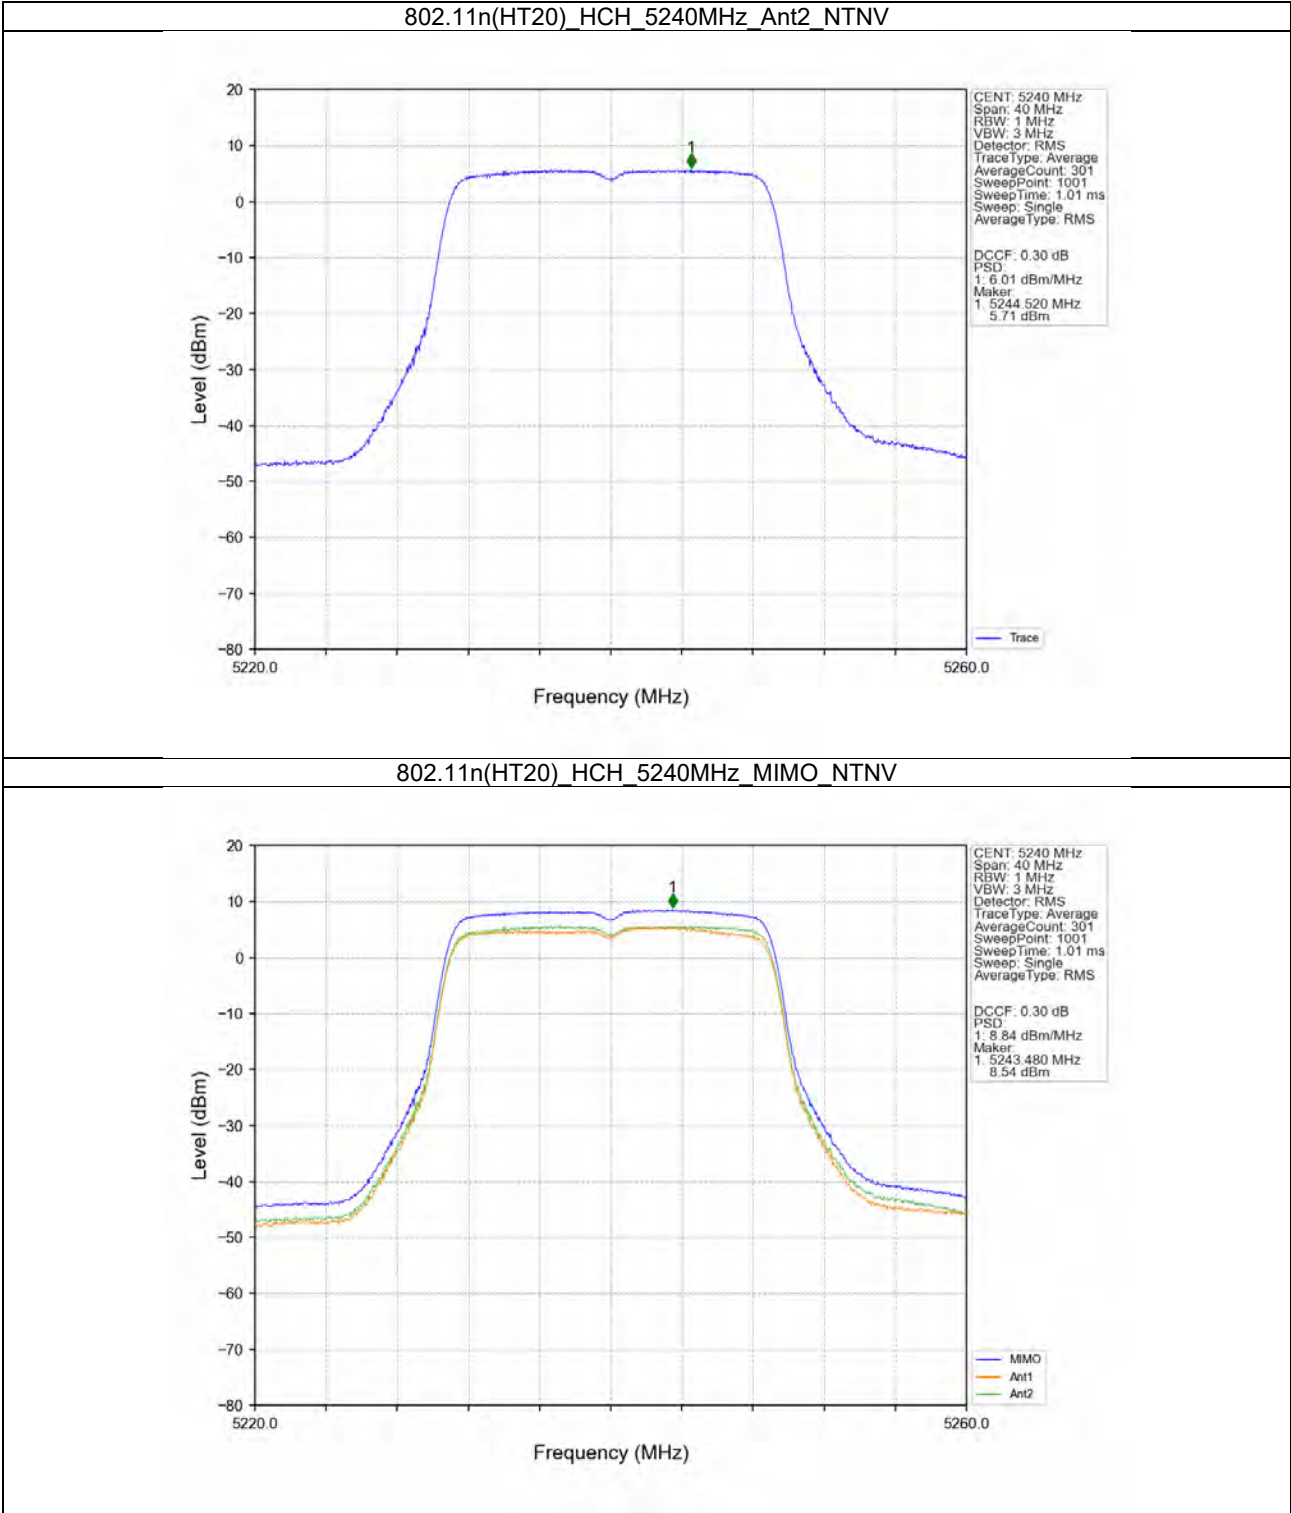





SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.

Report No.: SUCR250300017004
Rev.: 01
Page: 345 of 1085


802.11n(HT20)_LCH_5260MHz_Ant1_NTNV

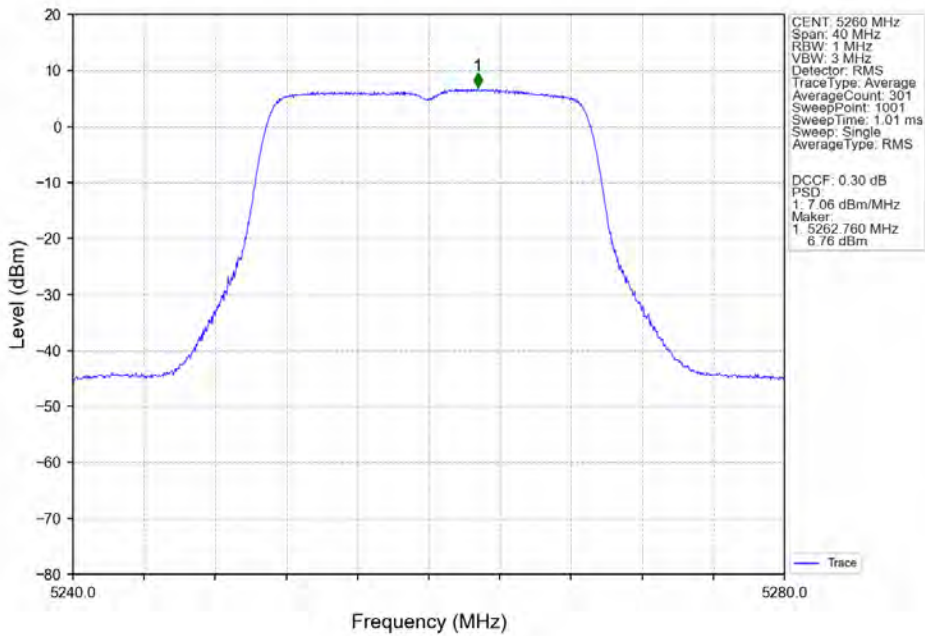


802.11n(HT20)_LCH_5260MHz_Ant2_NTNV

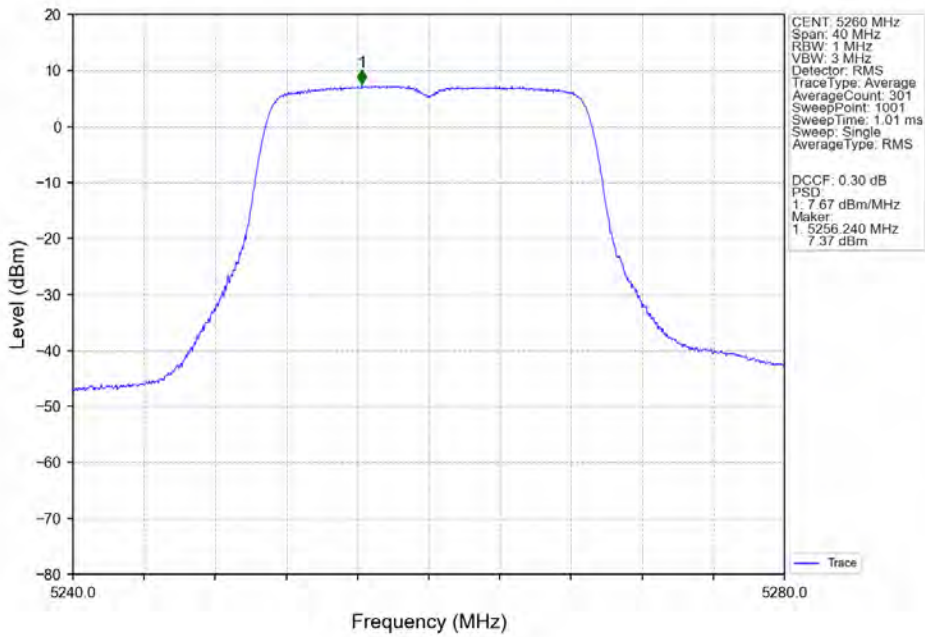

802.11n(HT20)_LCH_5260MHz_MIMO_NTNV

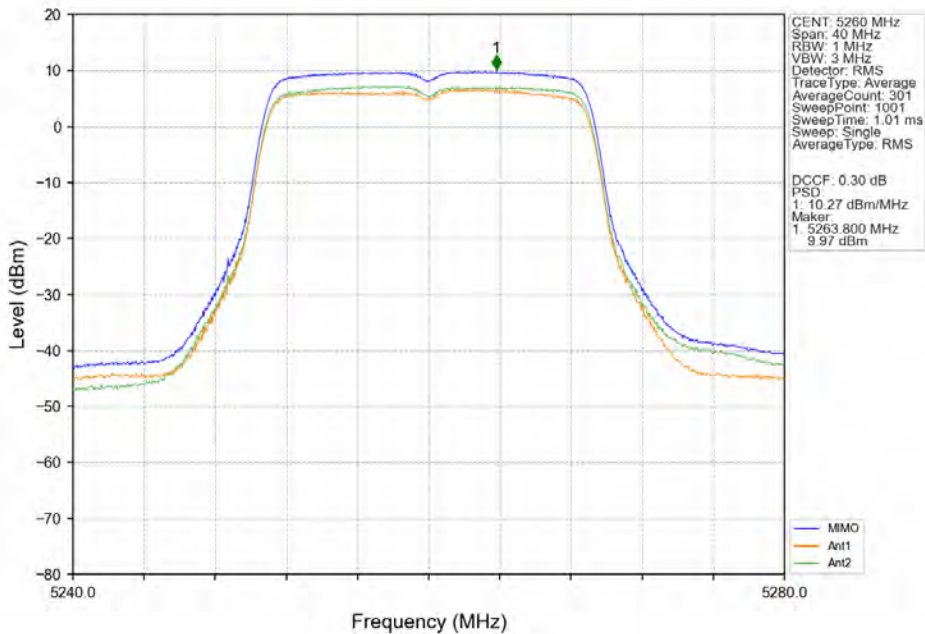


802.11n(HT20)_MCH_5300MHz_Ant1_NTNV

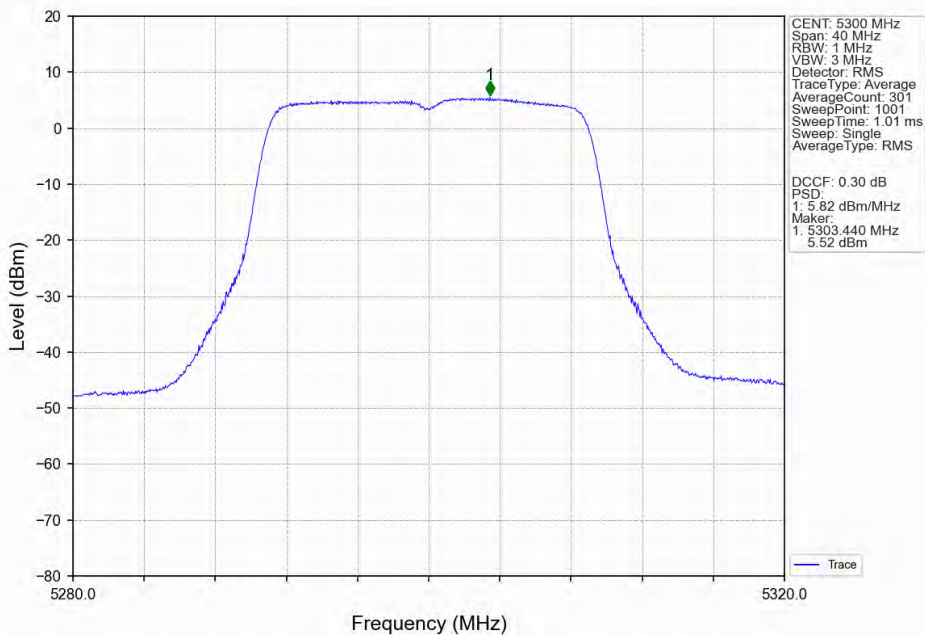



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 347 of 1085

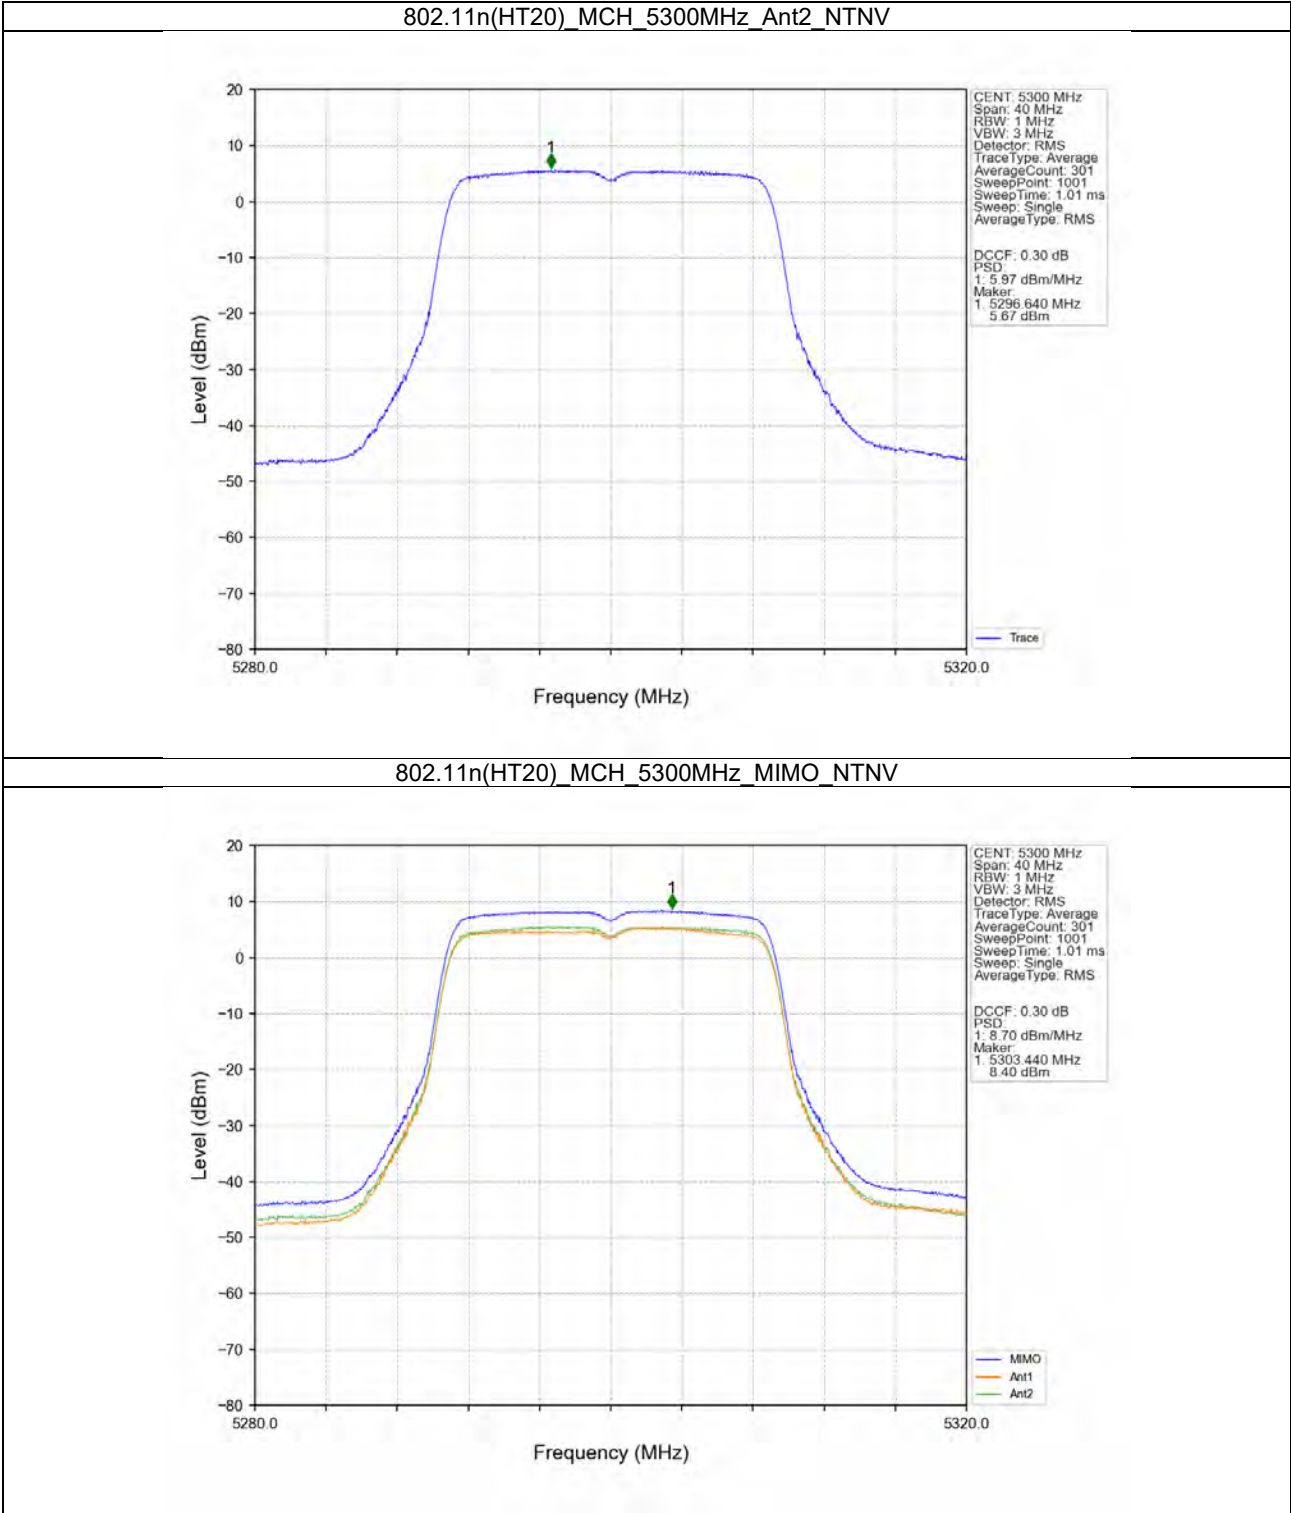



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 348 of 1085

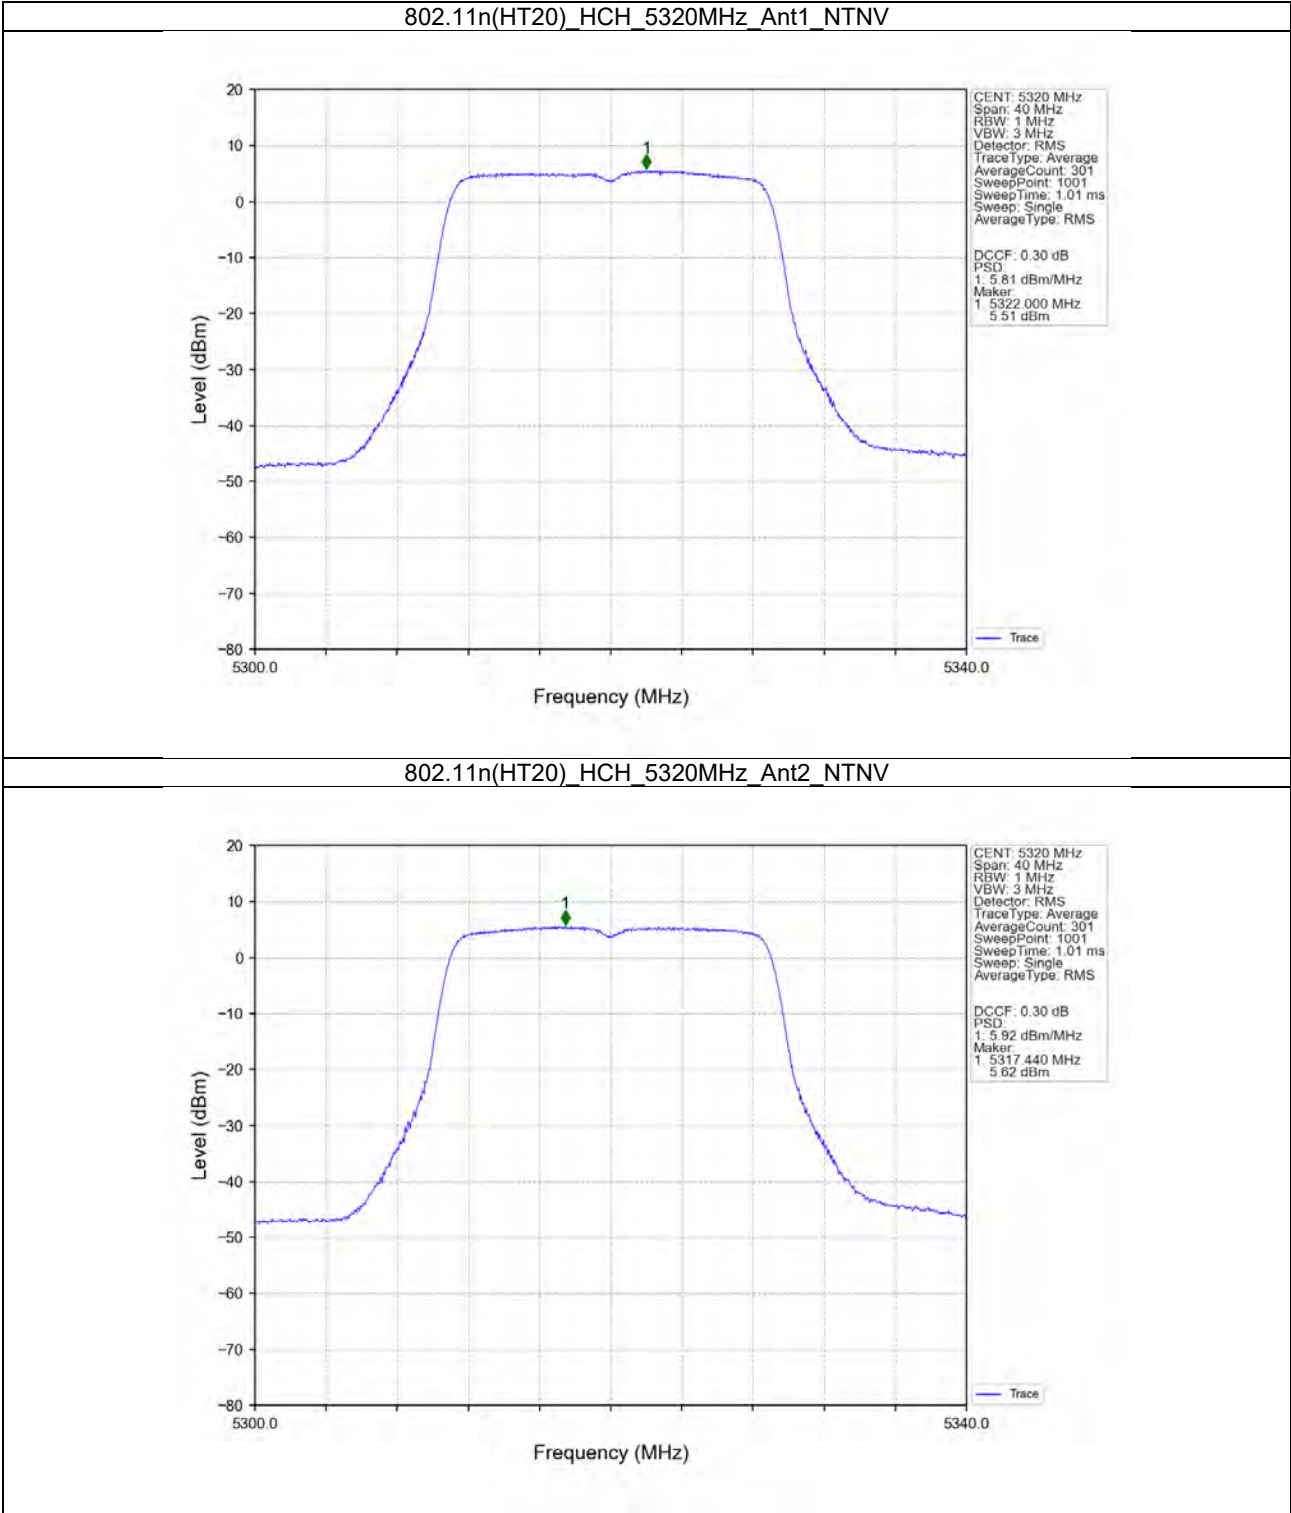



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 349 of 1085

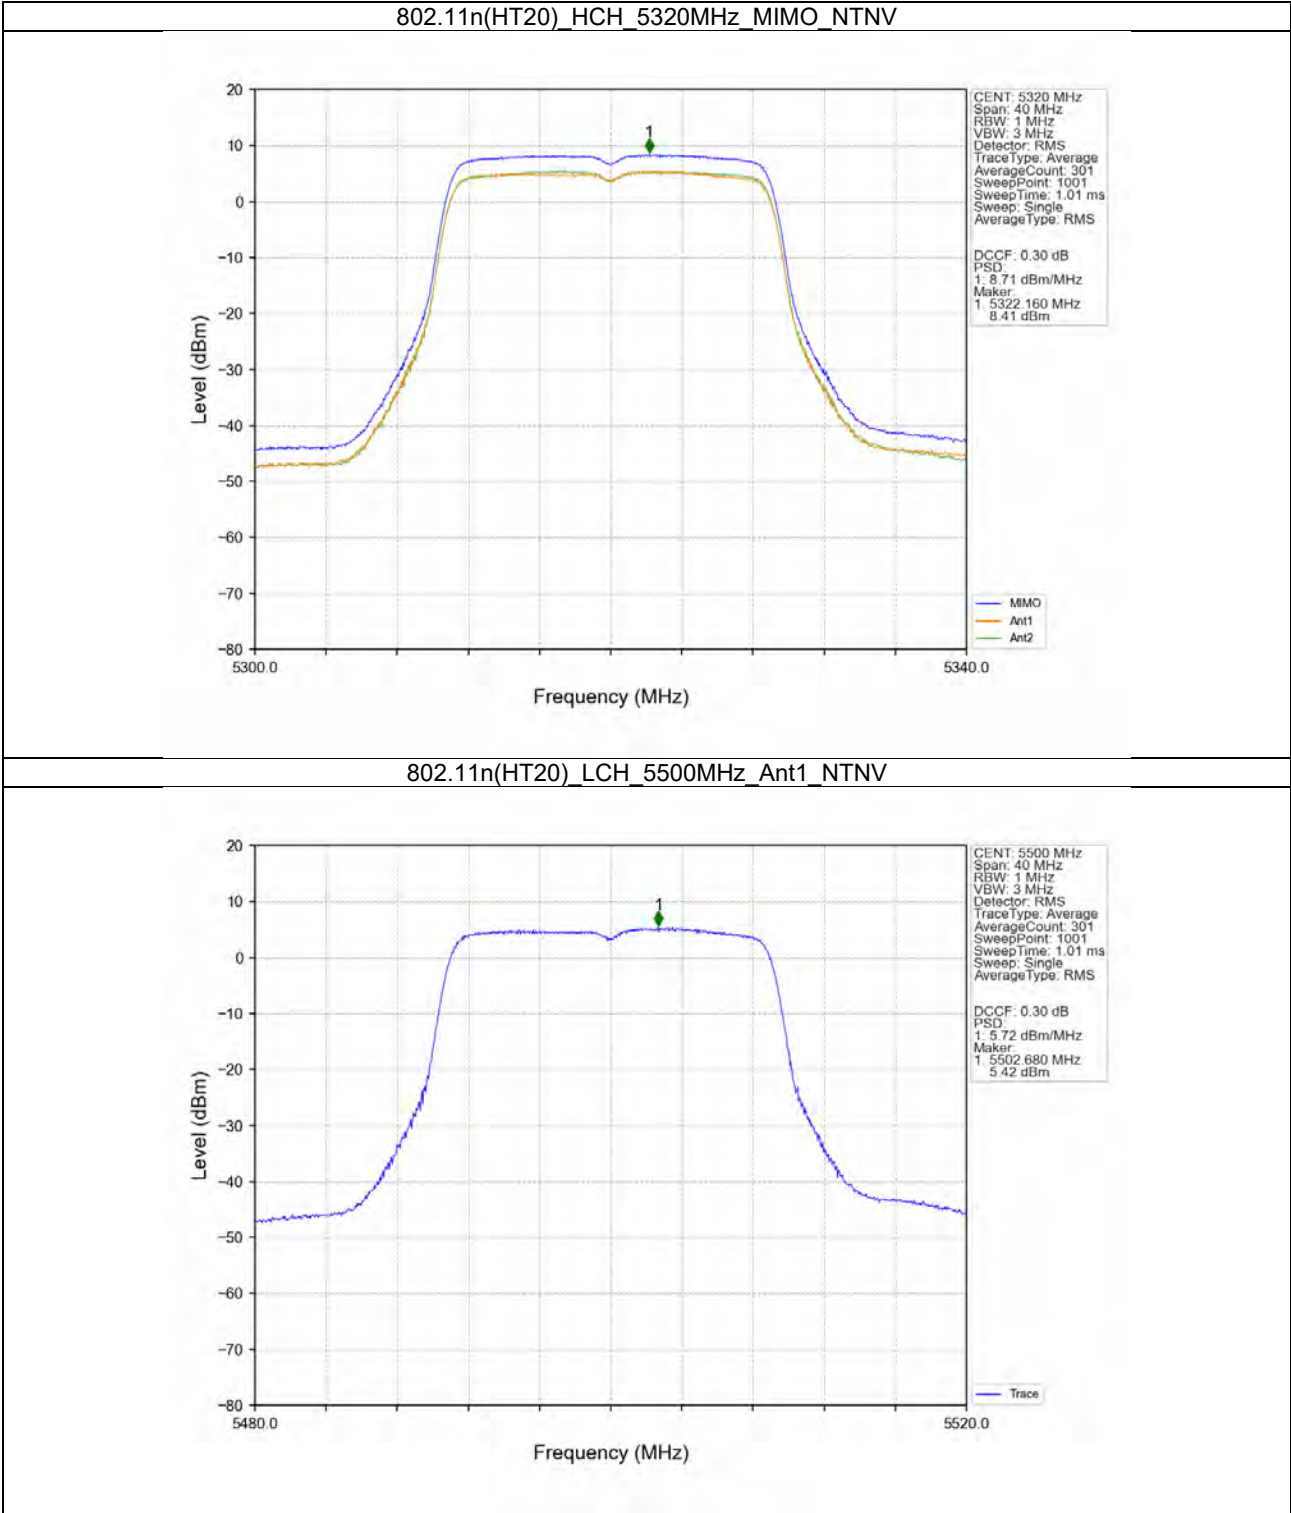



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 350 of 1085

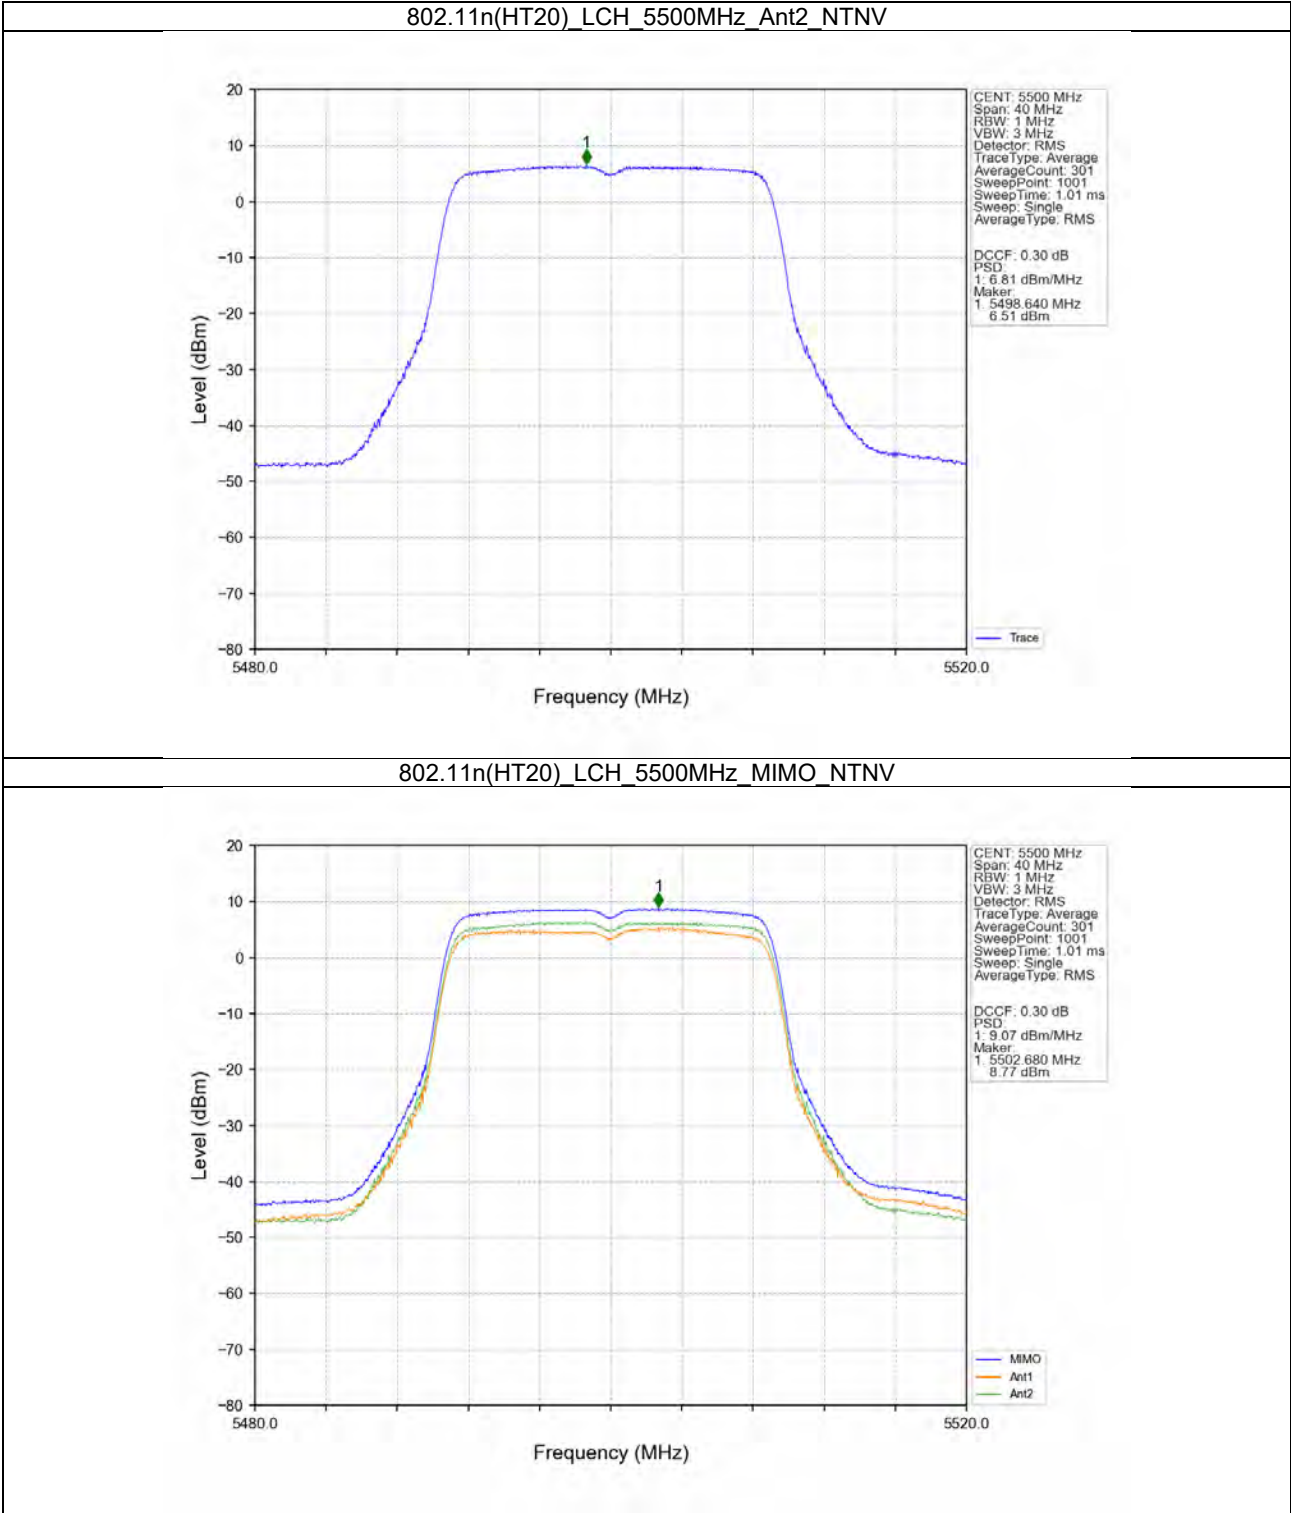



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 351 of 1085

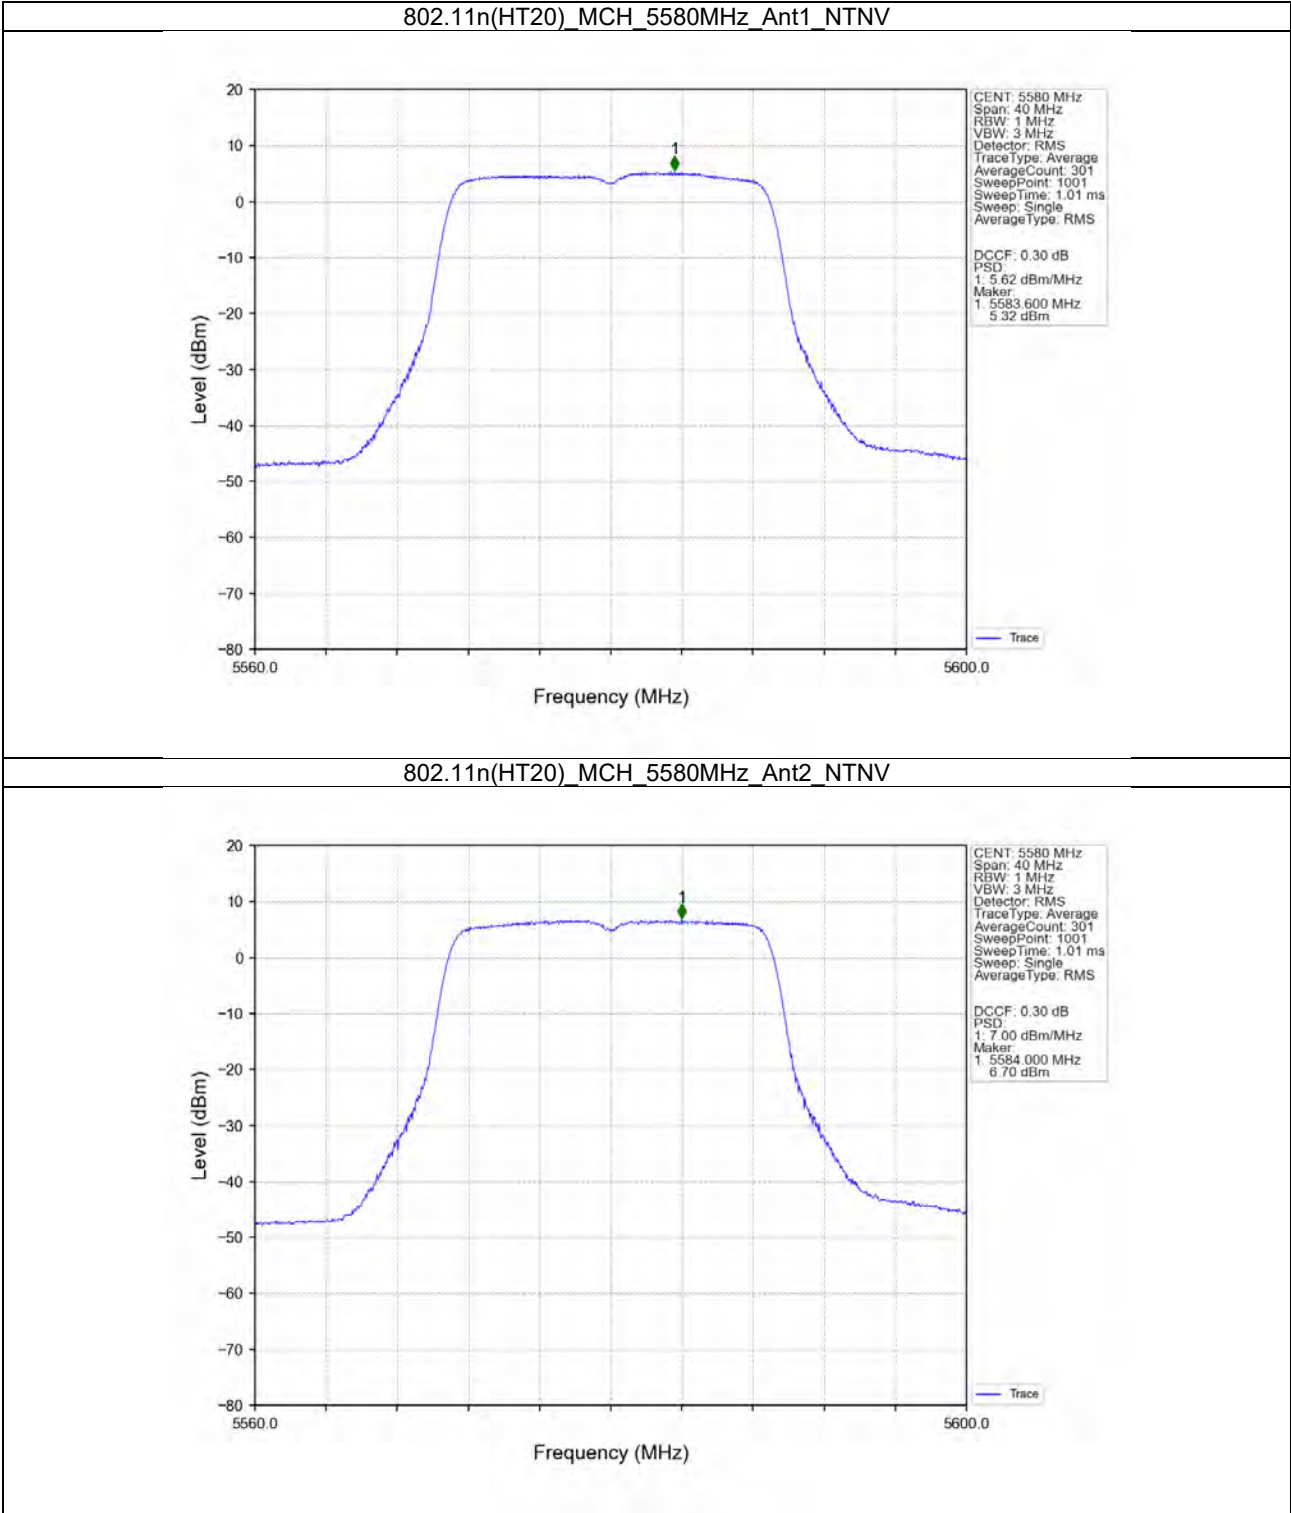



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 352 of 1085

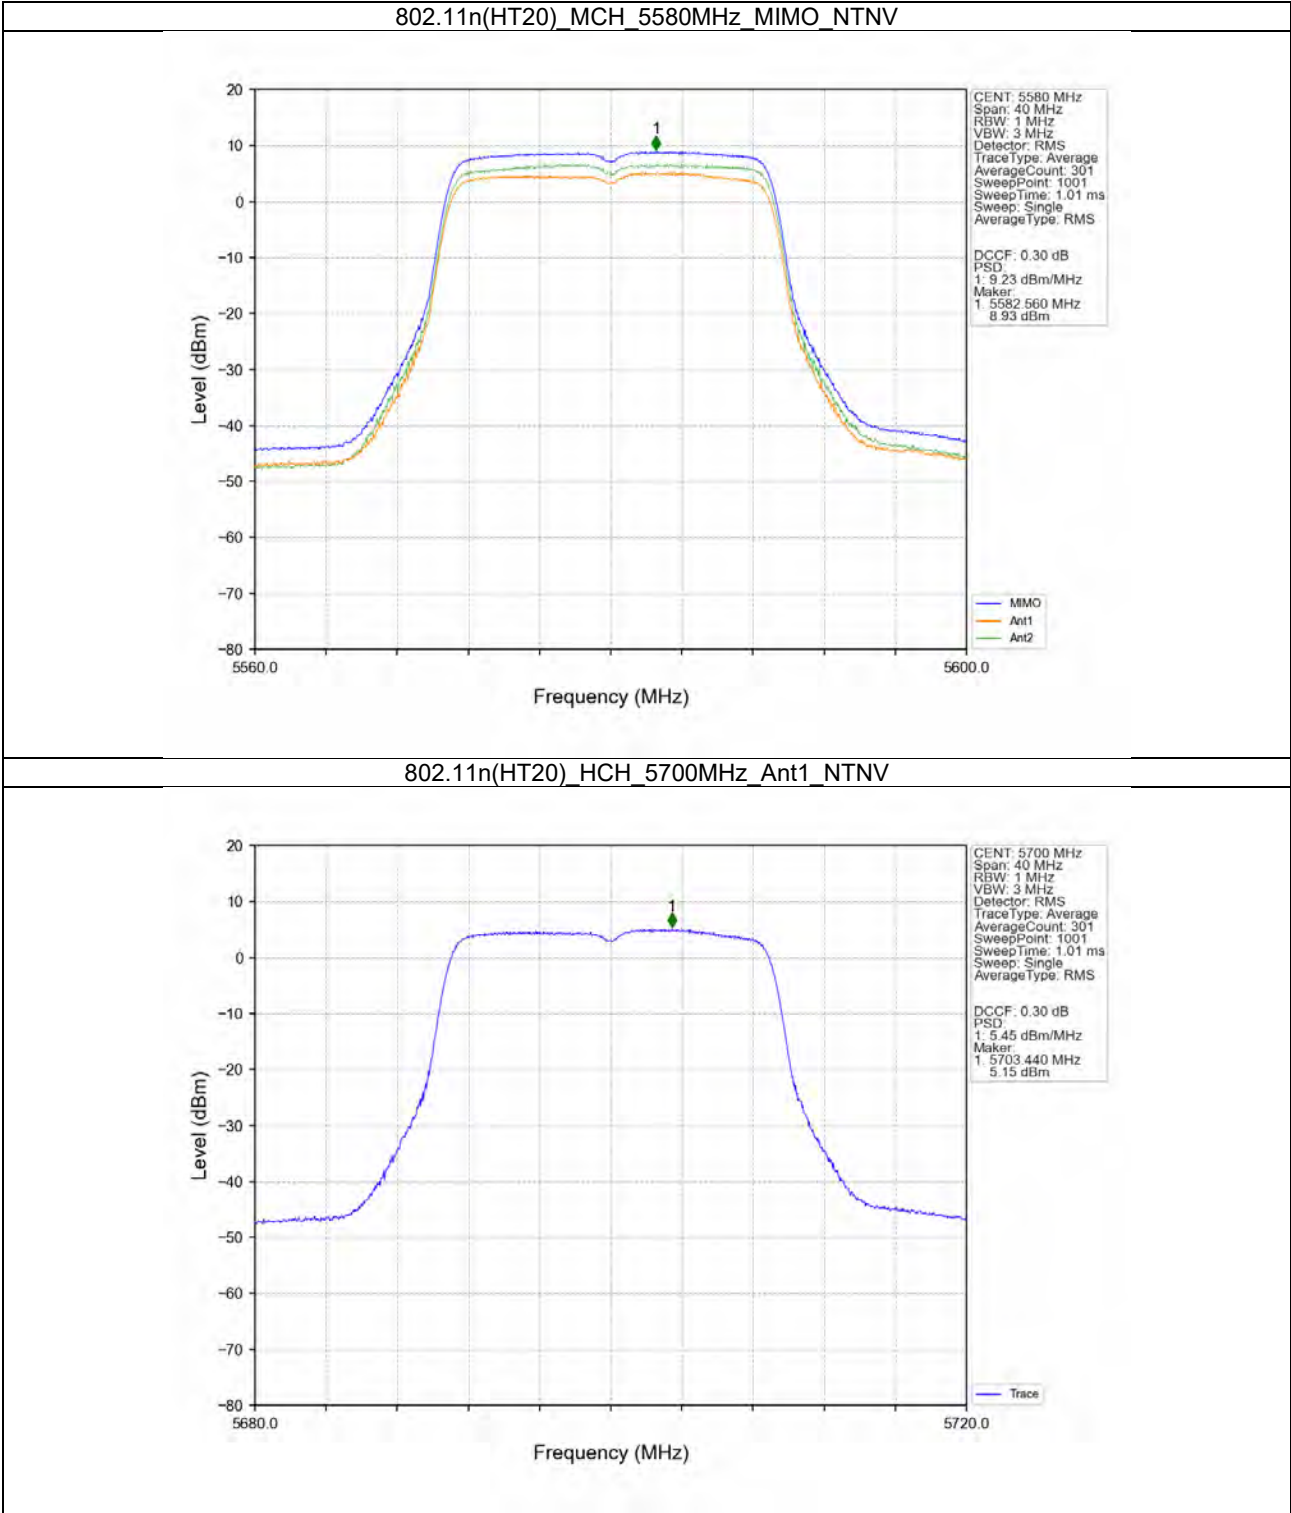



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.

Report No.: SUCR250300017004
Rev.: 01
Page: 353 of 1085

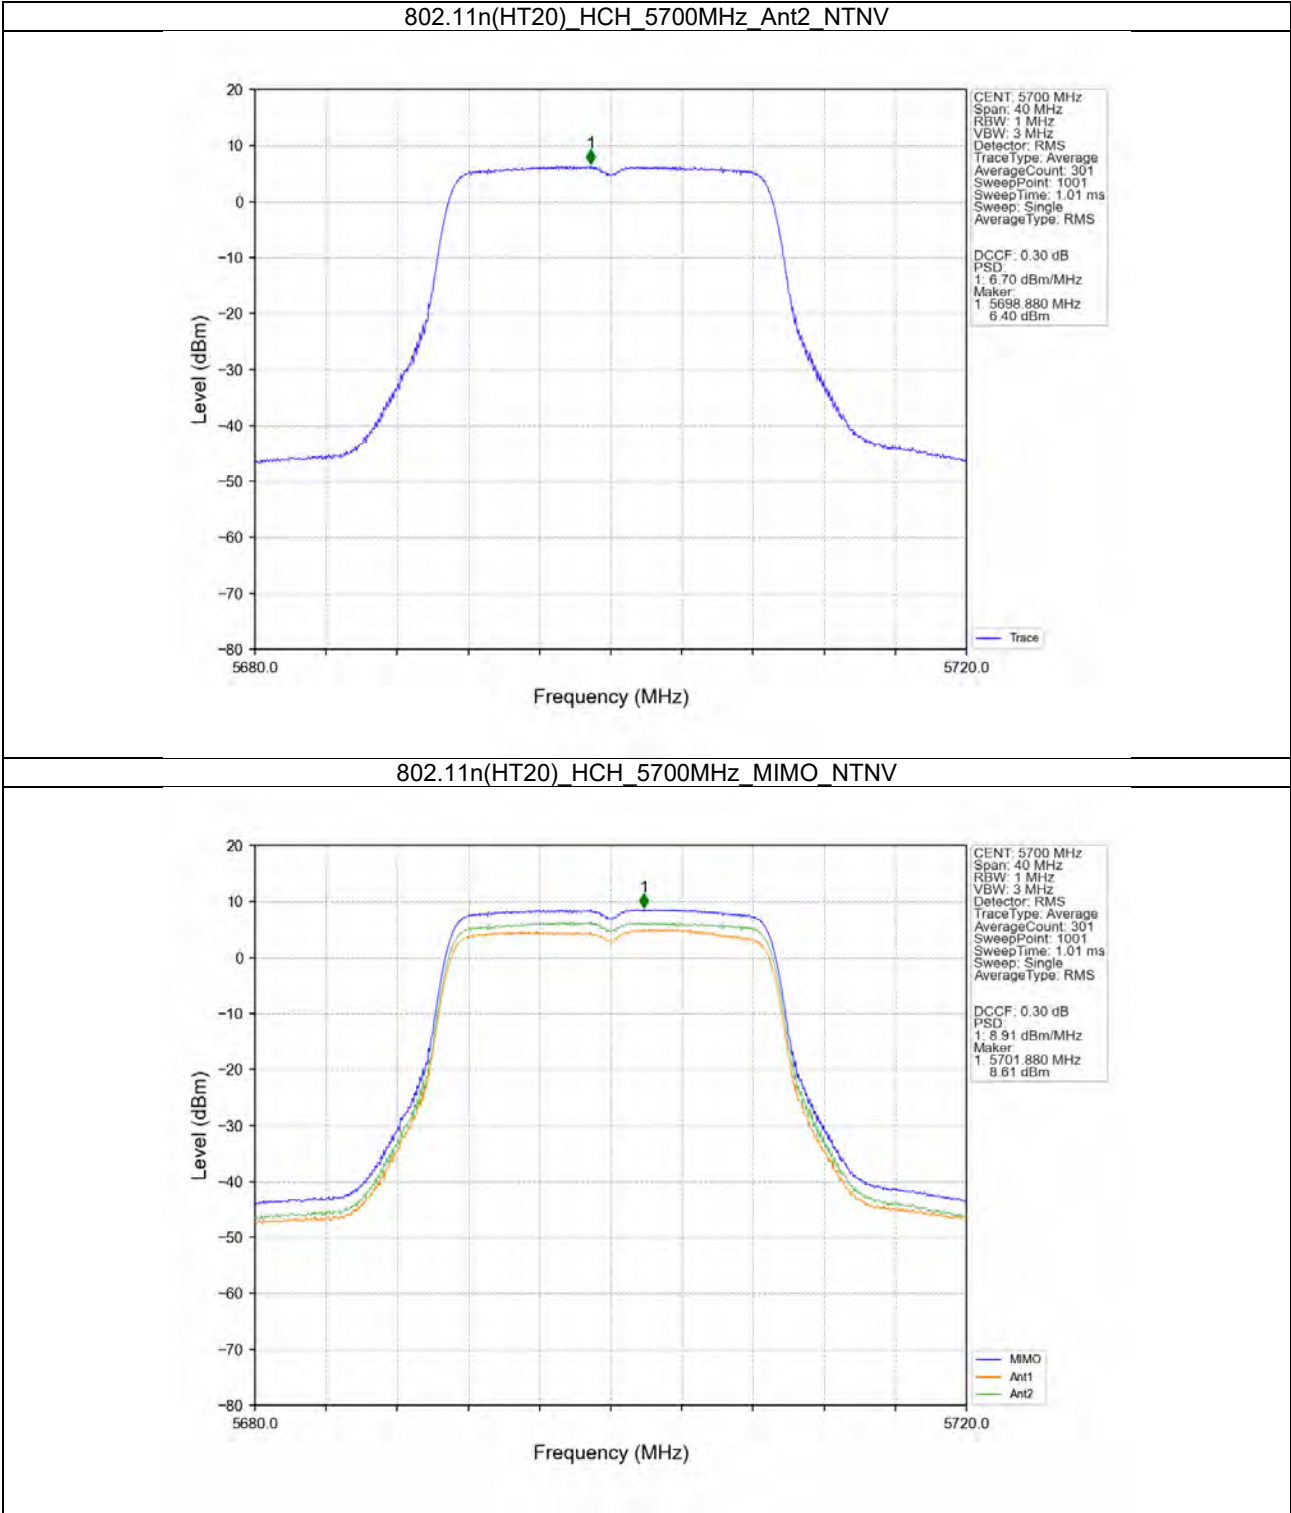





SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.

Report No.: SUCR250300017004
Rev.: 01
Page: 354 of 1085


802.11n(HT40)_LCH_5190MHz_Ant1_NTNV

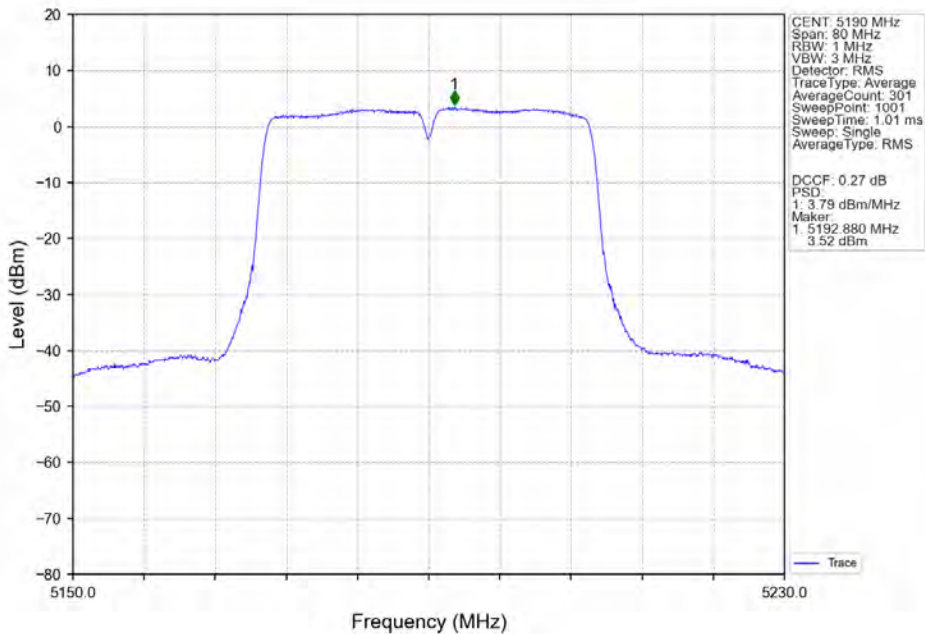


802.11n(HT40)_LCH_5190MHz_Ant2_NTNV

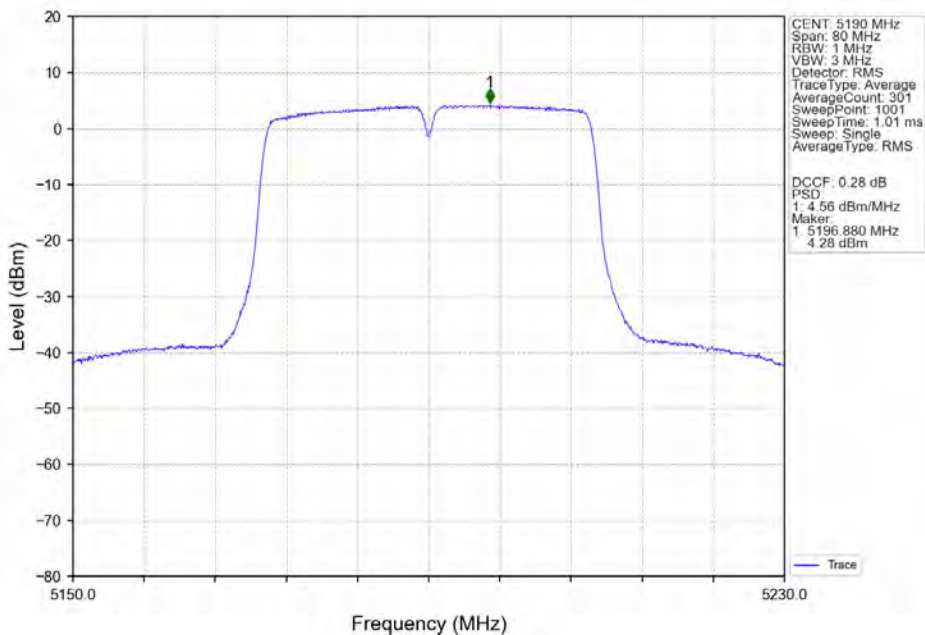

802.11n(HT40)_LCH_5190MHz_MIMO_NTNV

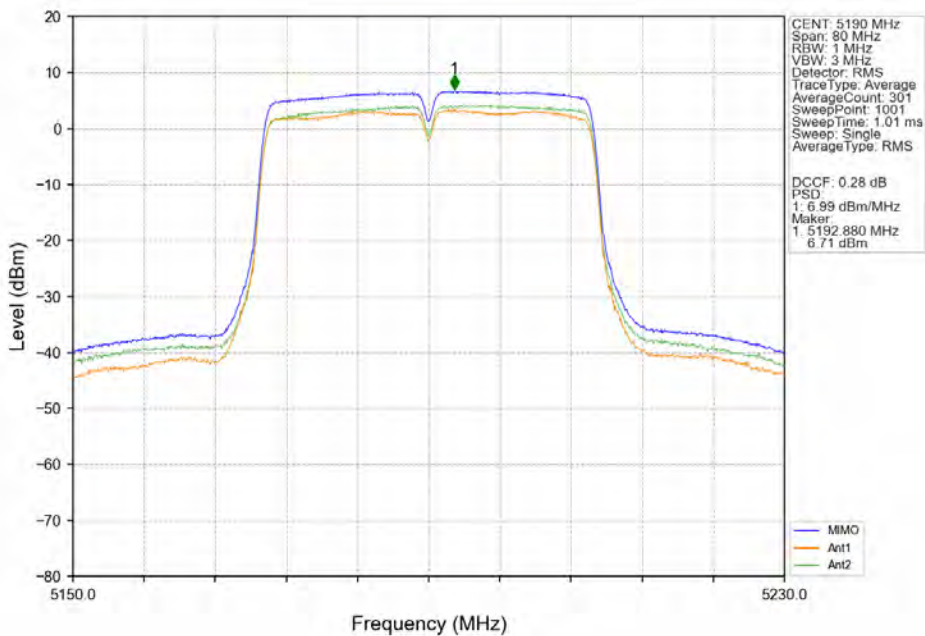


802.11n(HT40)_HCH_5230MHz_Ant1_NTNV

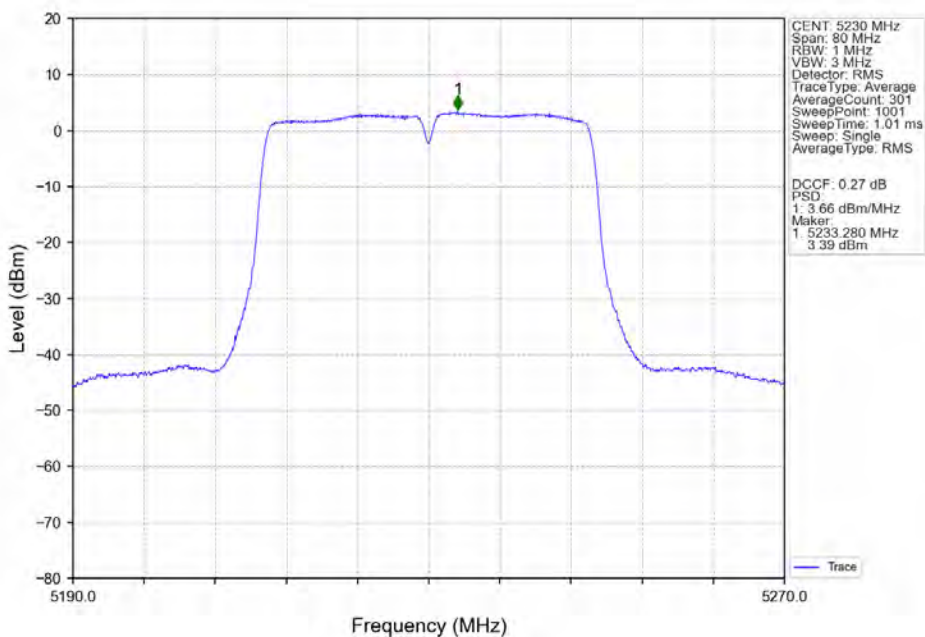



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.

Report No.: SUCR250300017004
Rev.: 01
Page: 356 of 1085

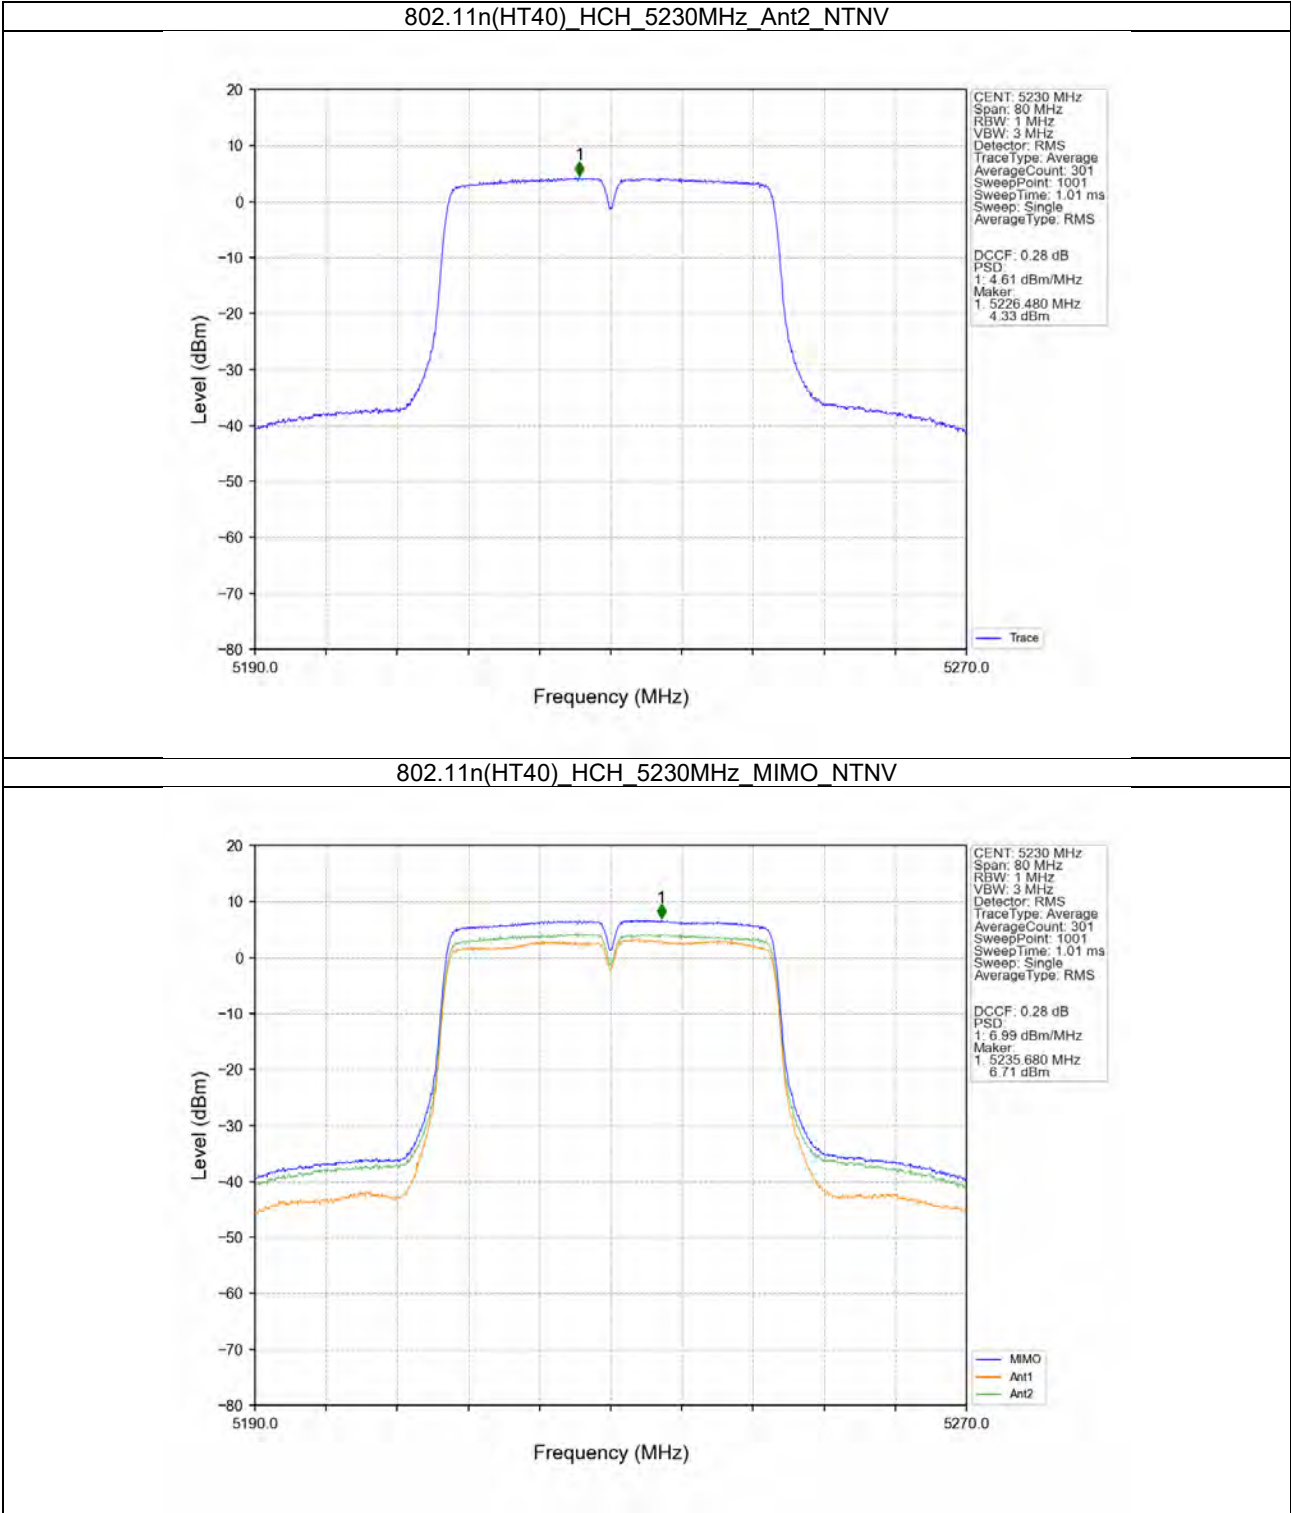





SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.

Report No.: SUCR250300017004
Rev.: 01
Page: 357 of 1085


802.11n(HT40)_LCH_5270MHz_Ant1_NTNV

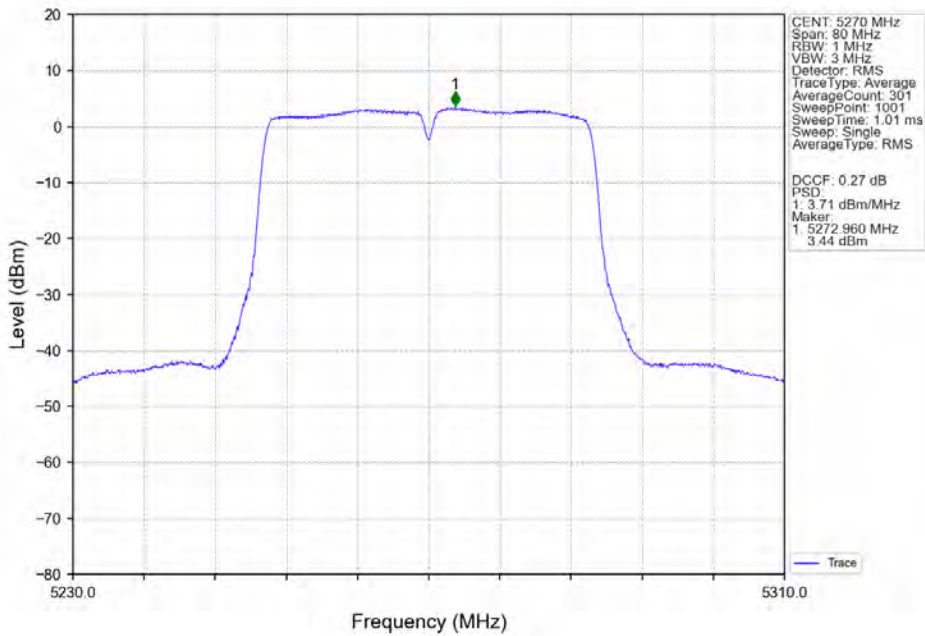


802.11n(HT40)_LCH_5270MHz_Ant2_NTNV

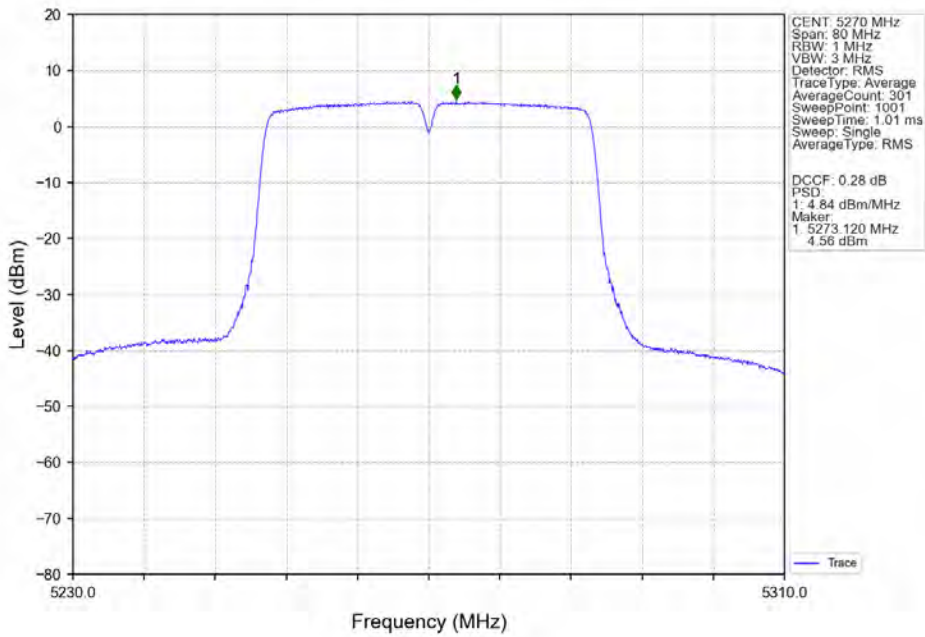

802.11n(HT40)_LCH_5270MHz_MIMO_NTNV

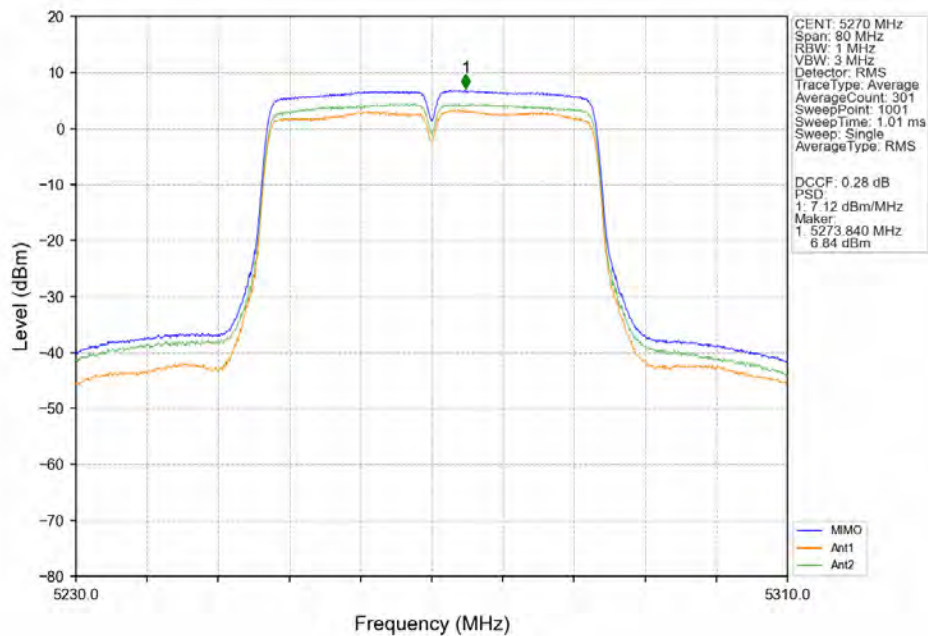


802.11n(HT40)_HCH_5310MHz_Ant1_NTNV

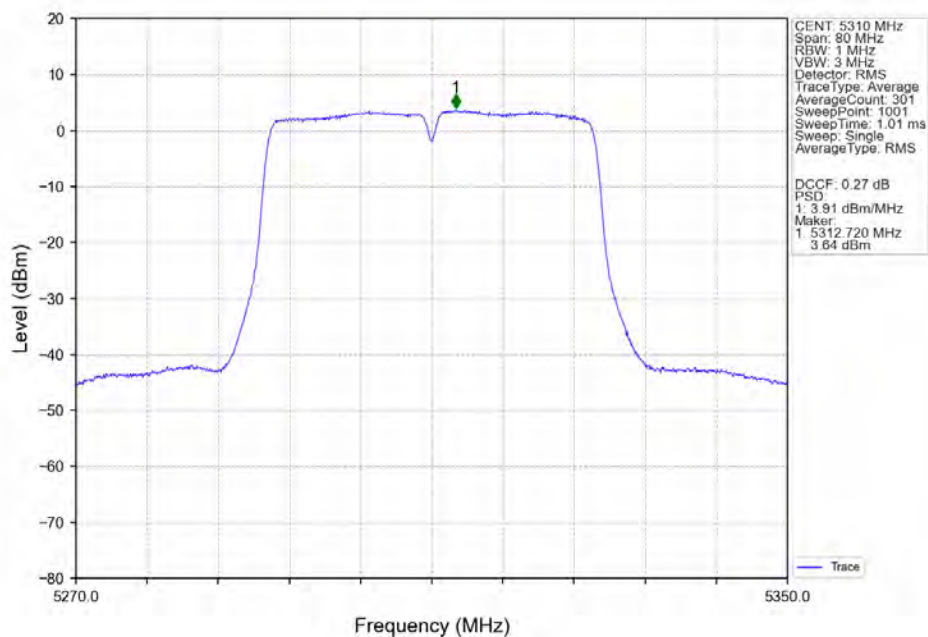



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.

Report No.: SUCR250300017004
Rev.: 01
Page: 359 of 1085

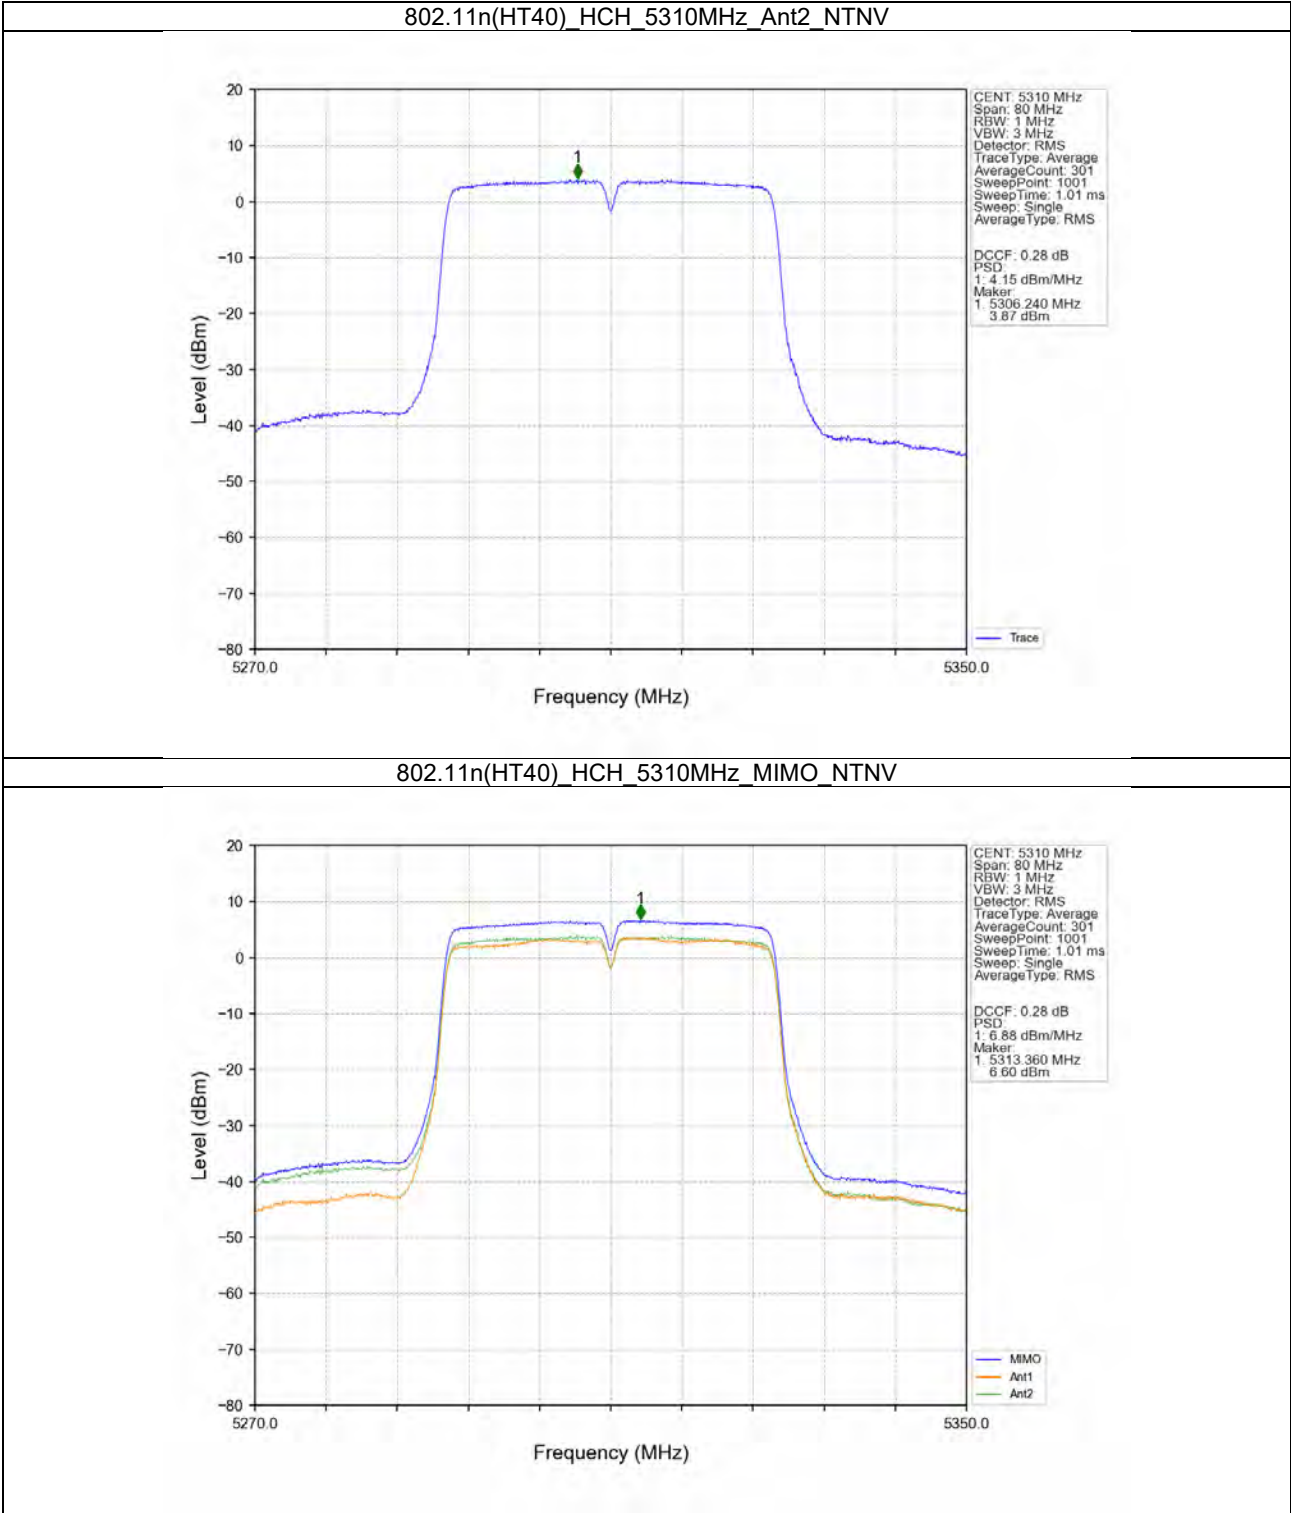





SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.

Report No.: SUCR250300017004
Rev.: 01
Page: 360 of 1085

802.11n(HT40)_LCH_5510MHz_Ant1_NTNV

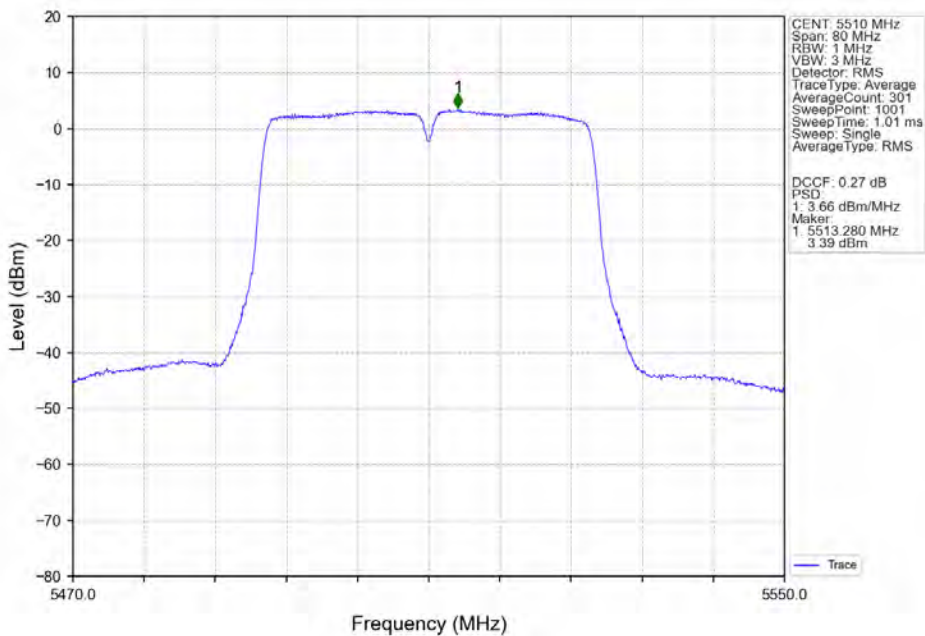


802.11n(HT40)_LCH_5510MHz_Ant2_NTNV

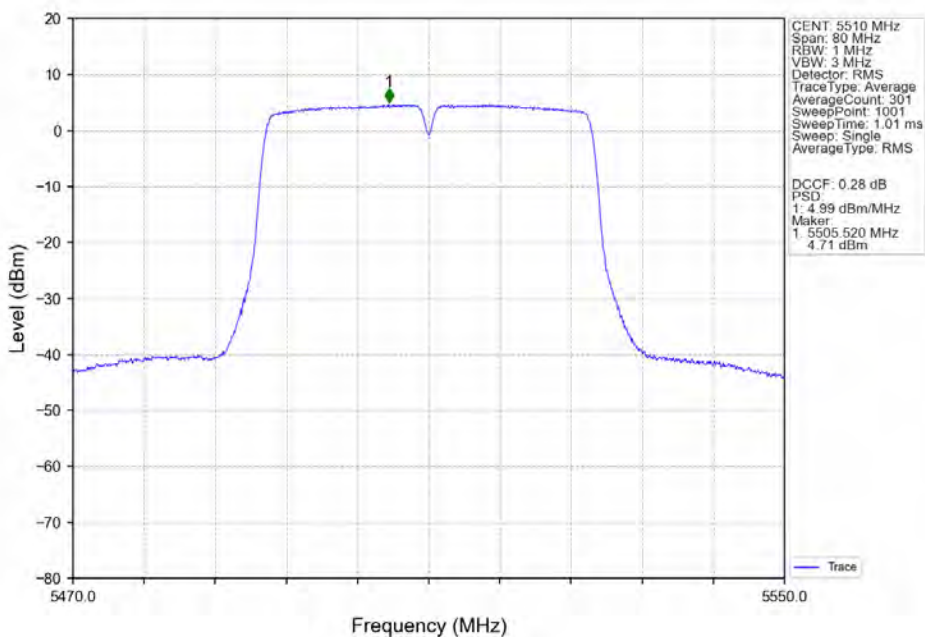



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 361 of 1085

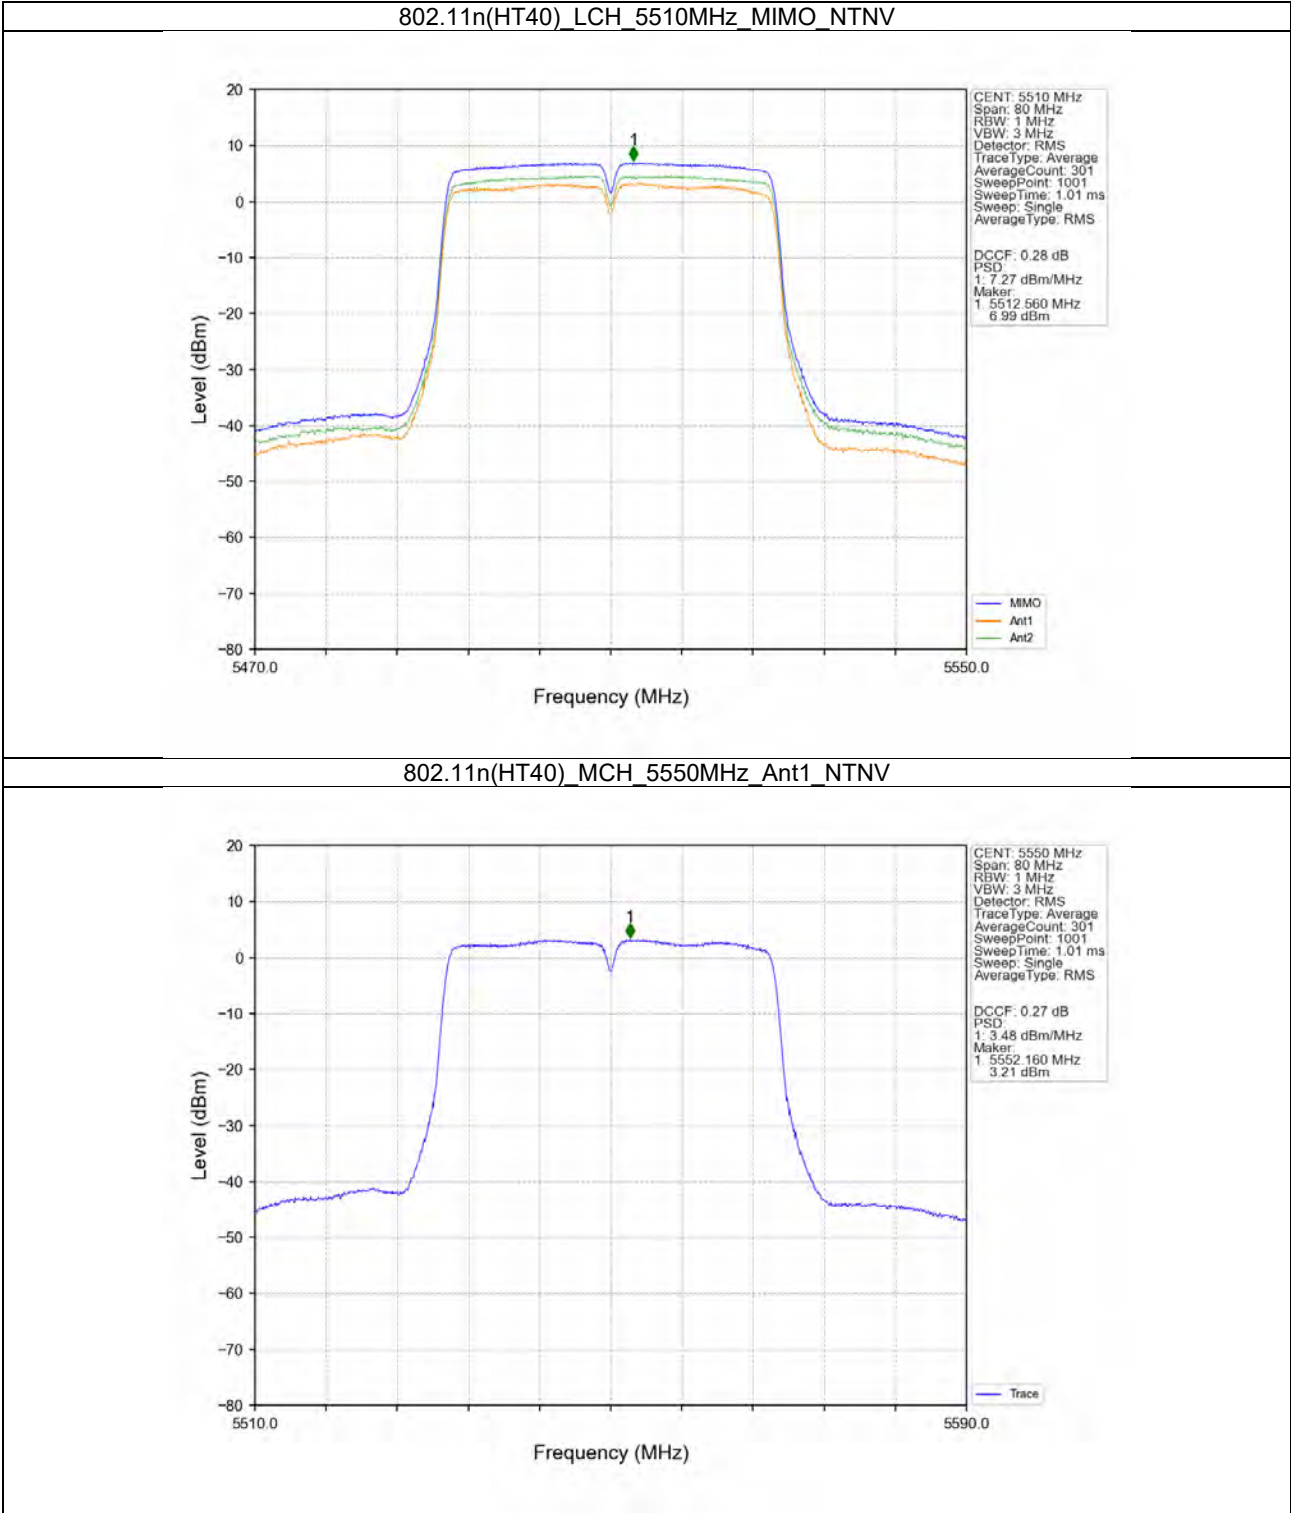



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 362 of 1085

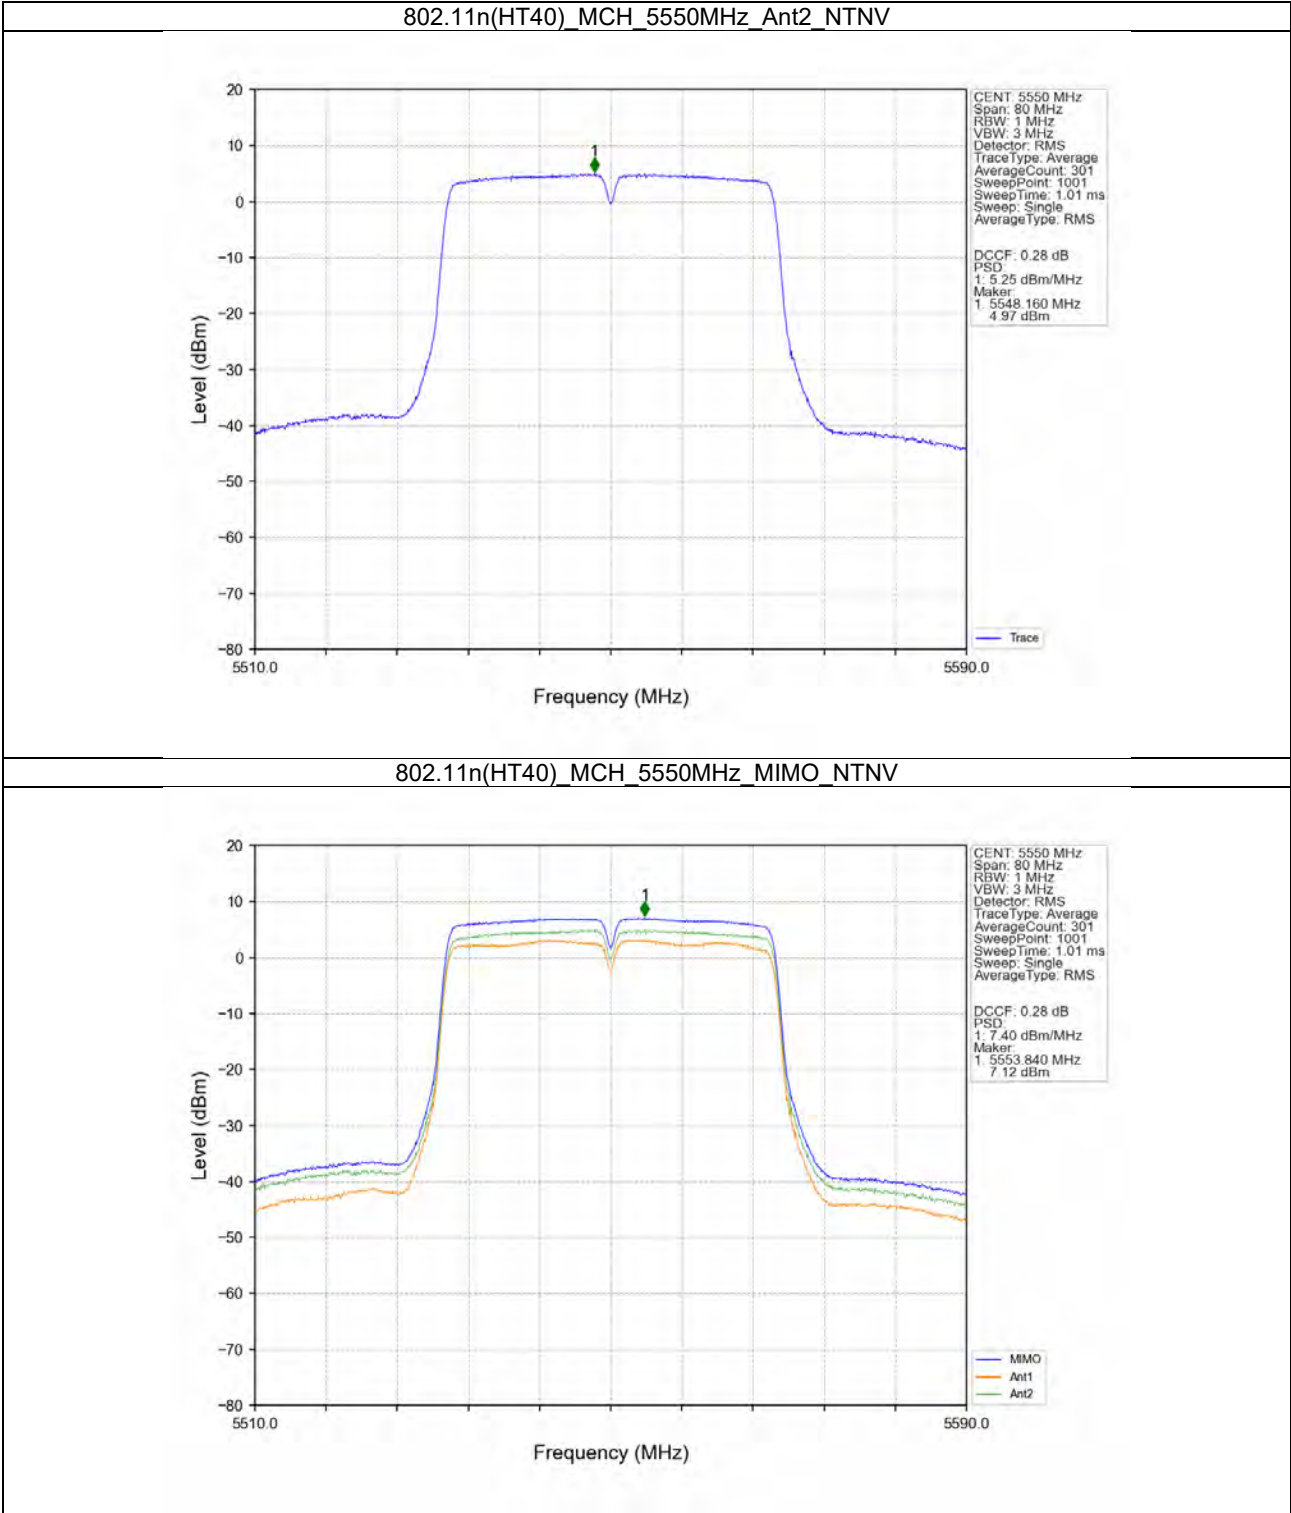



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 363 of 1085

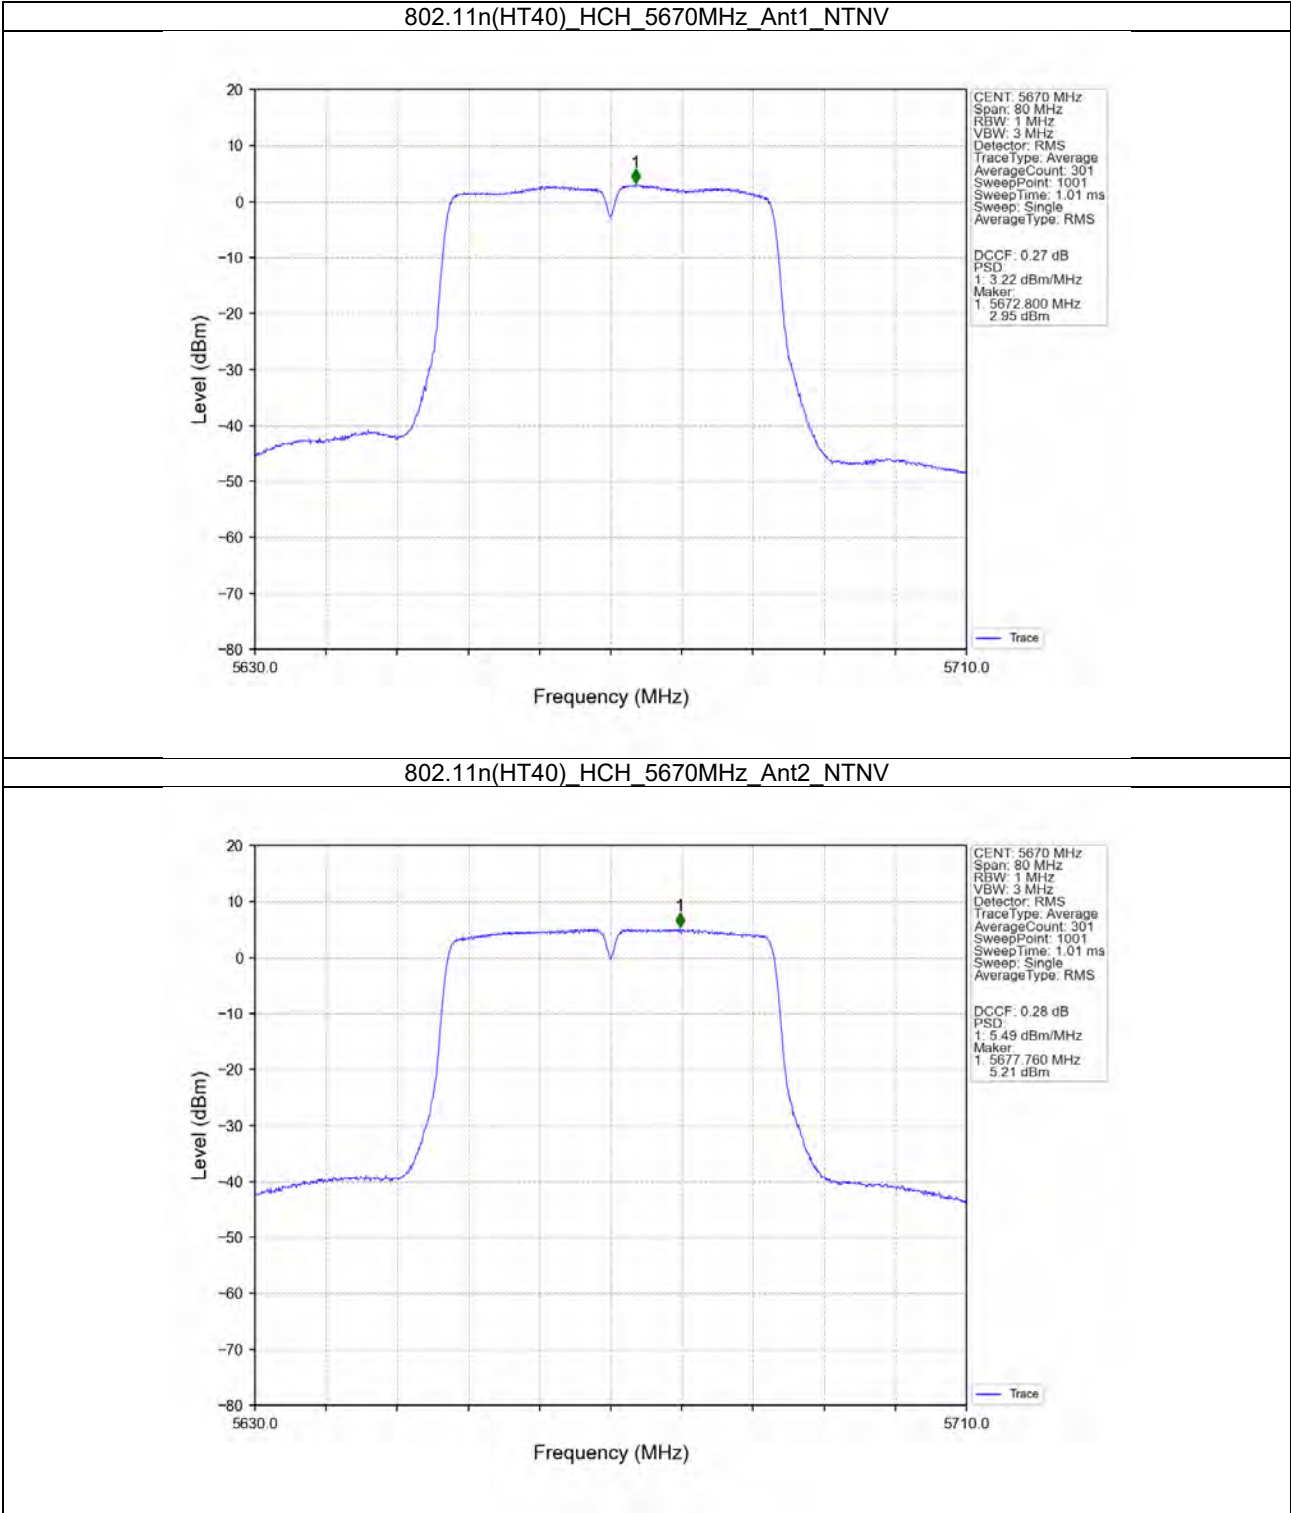



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 364 of 1085

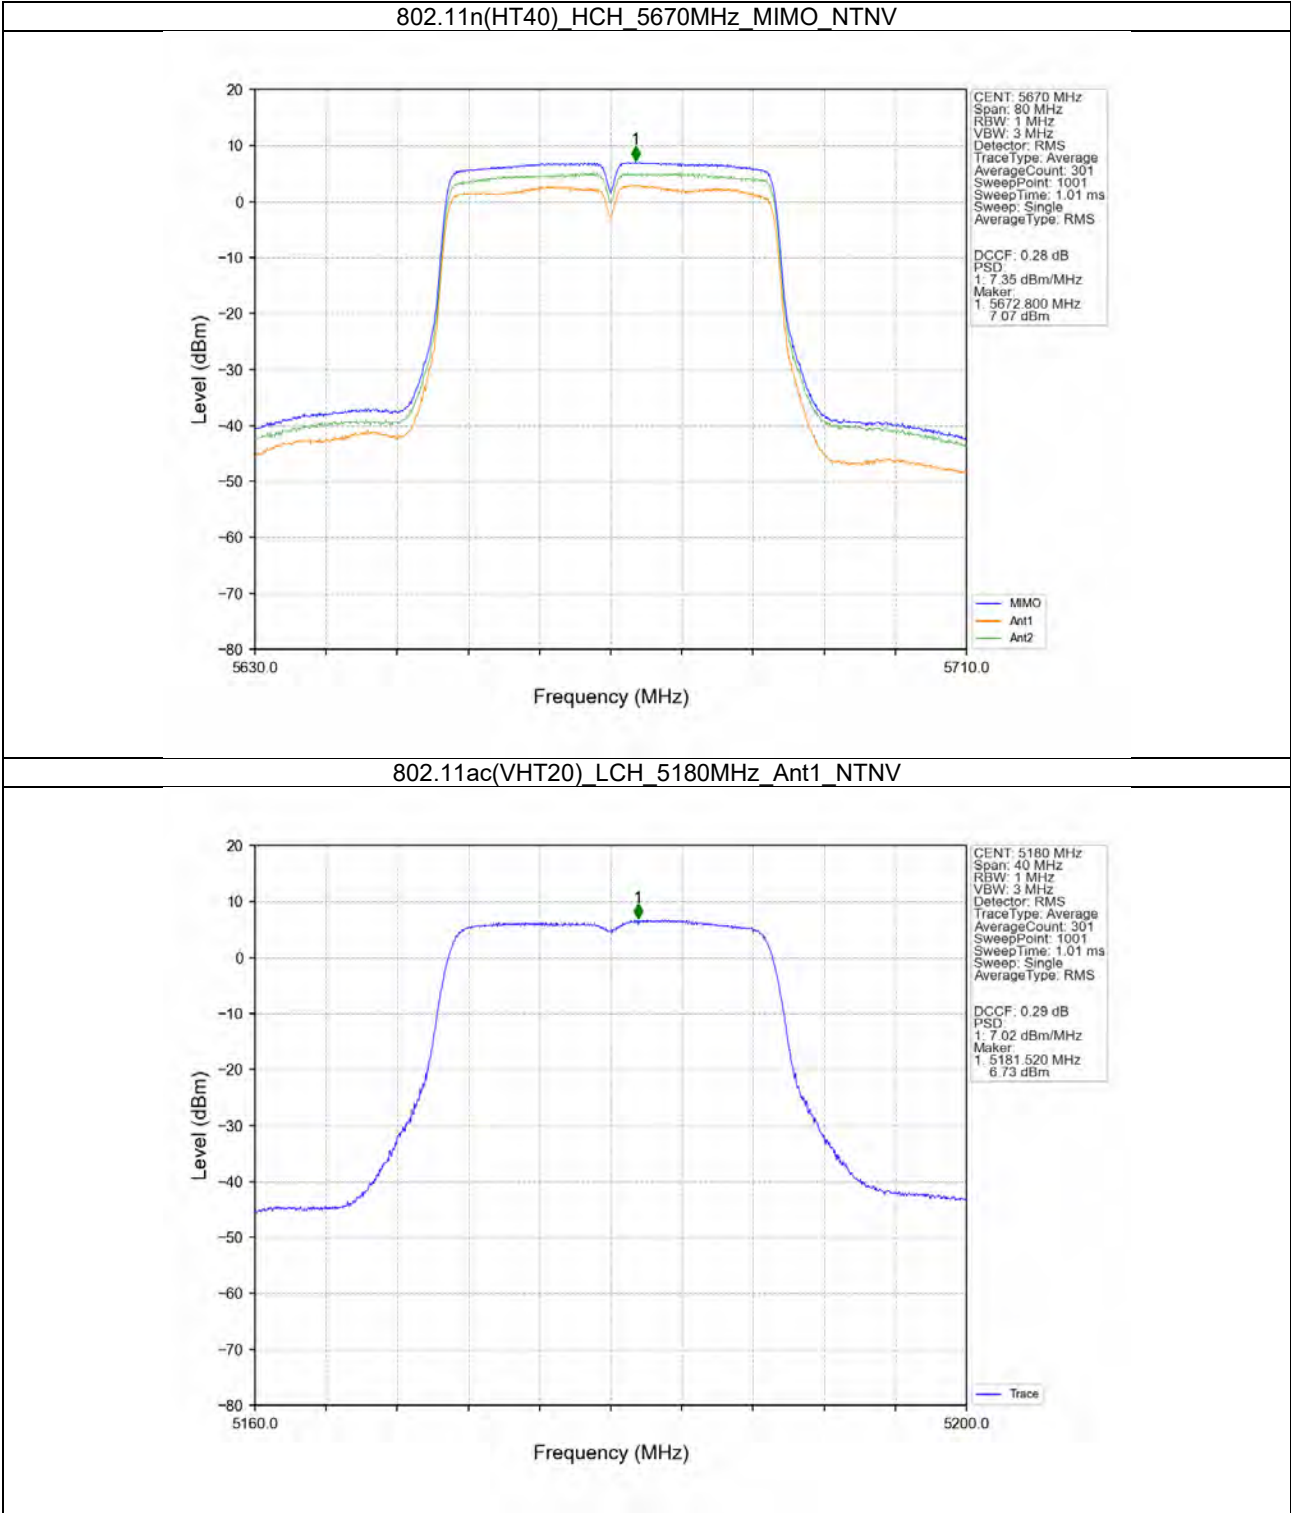



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 365 of 1085

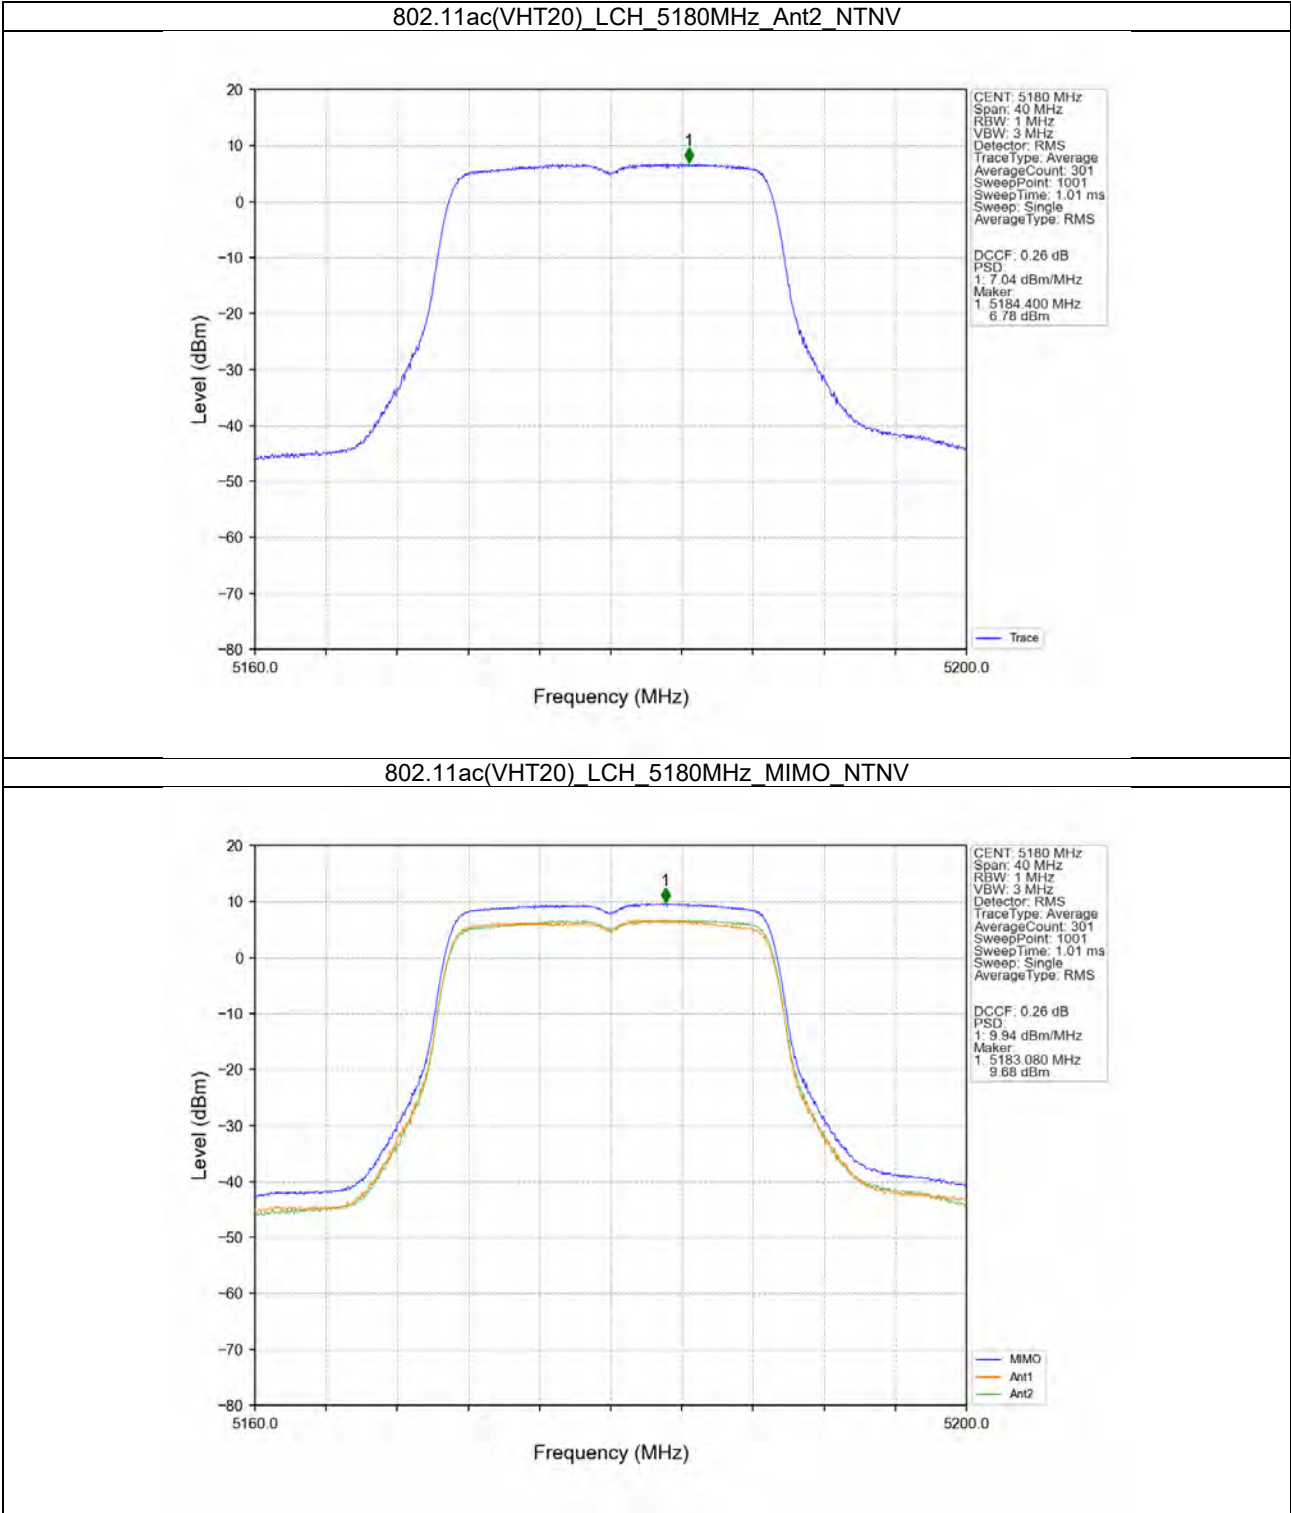



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 366 of 1085

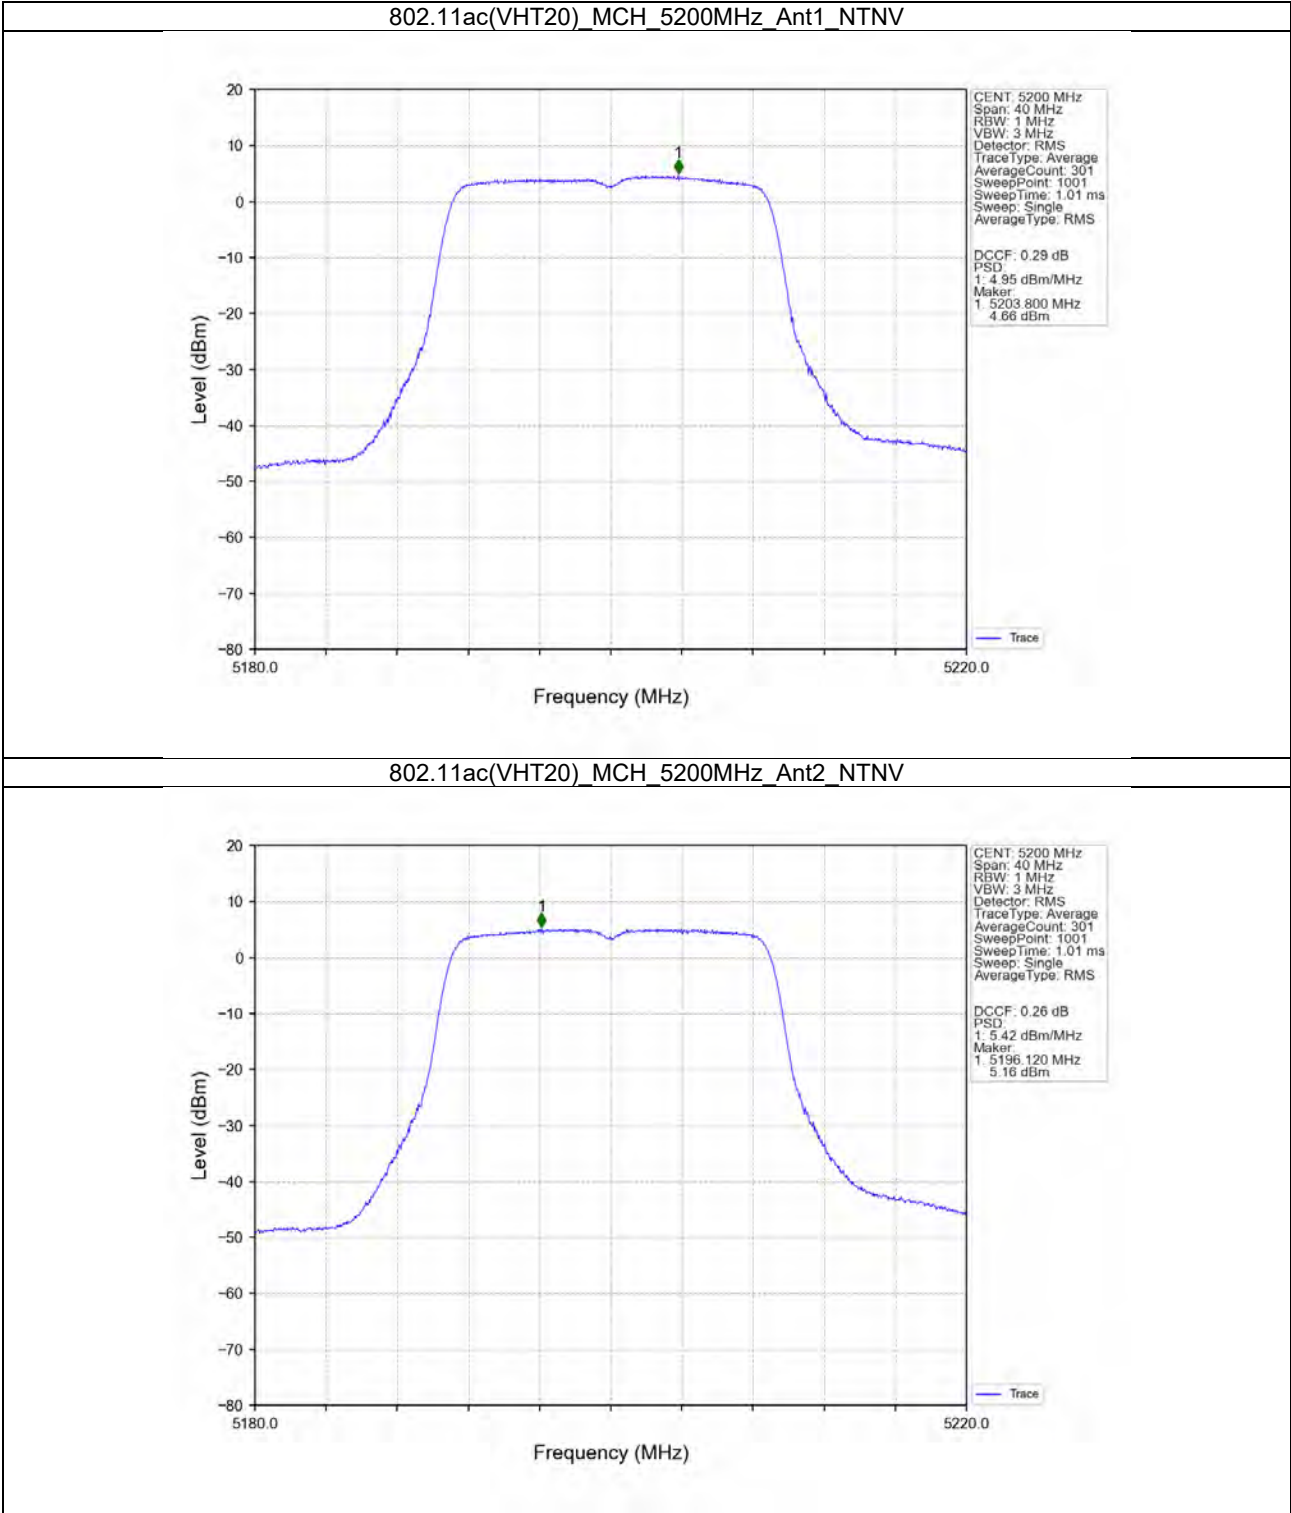



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 367 of 1085

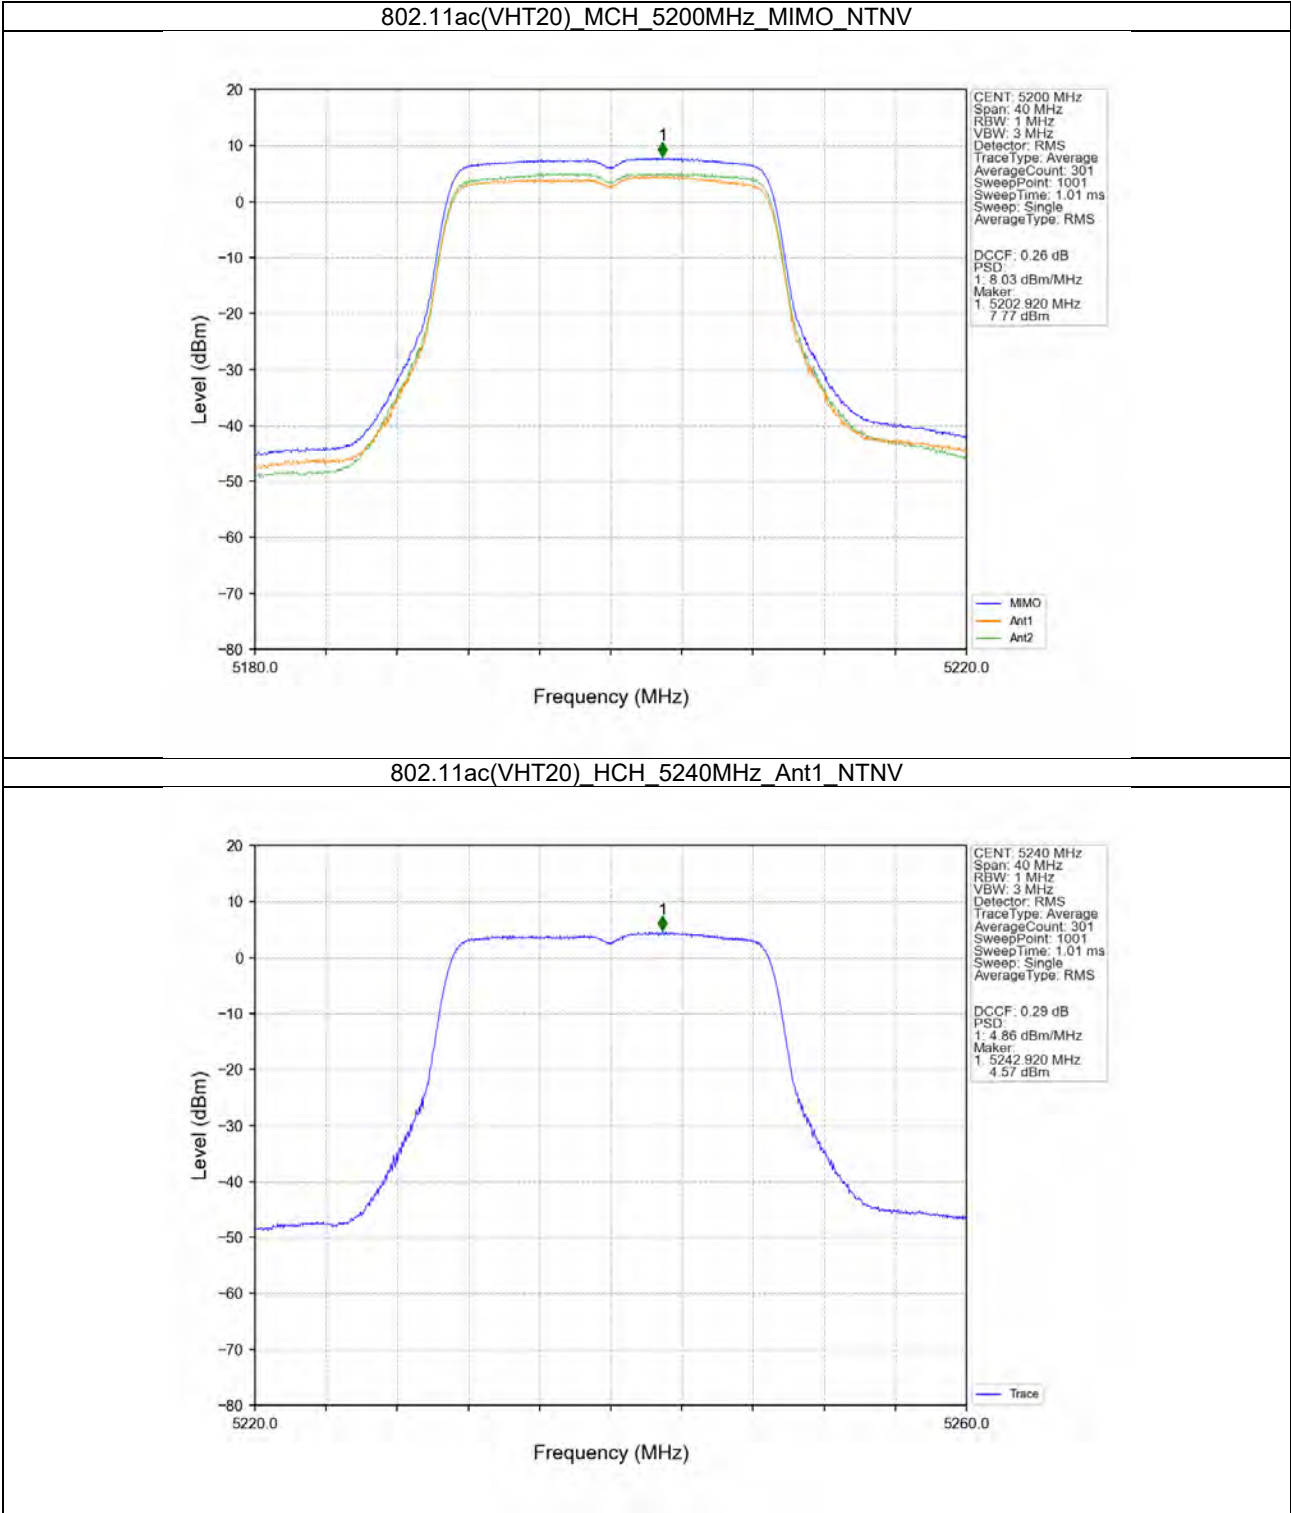



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 368 of 1085

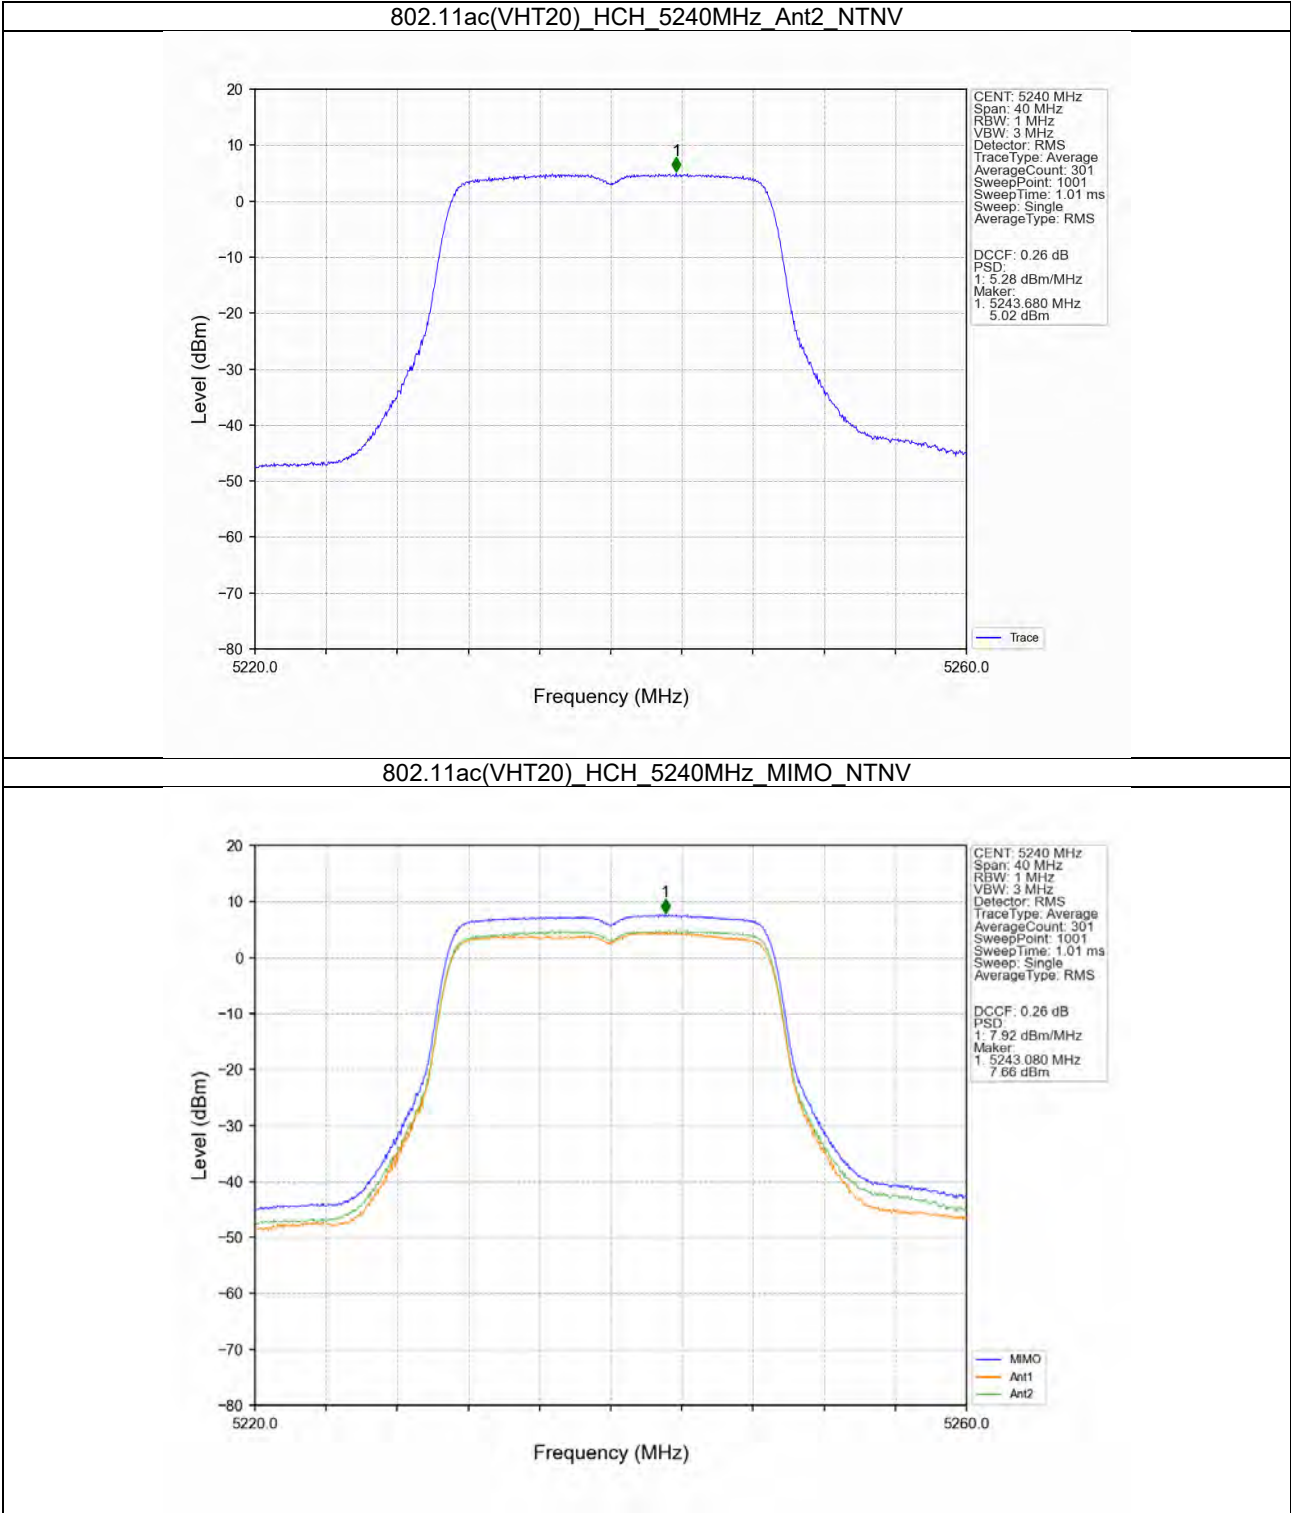



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 369 of 1085

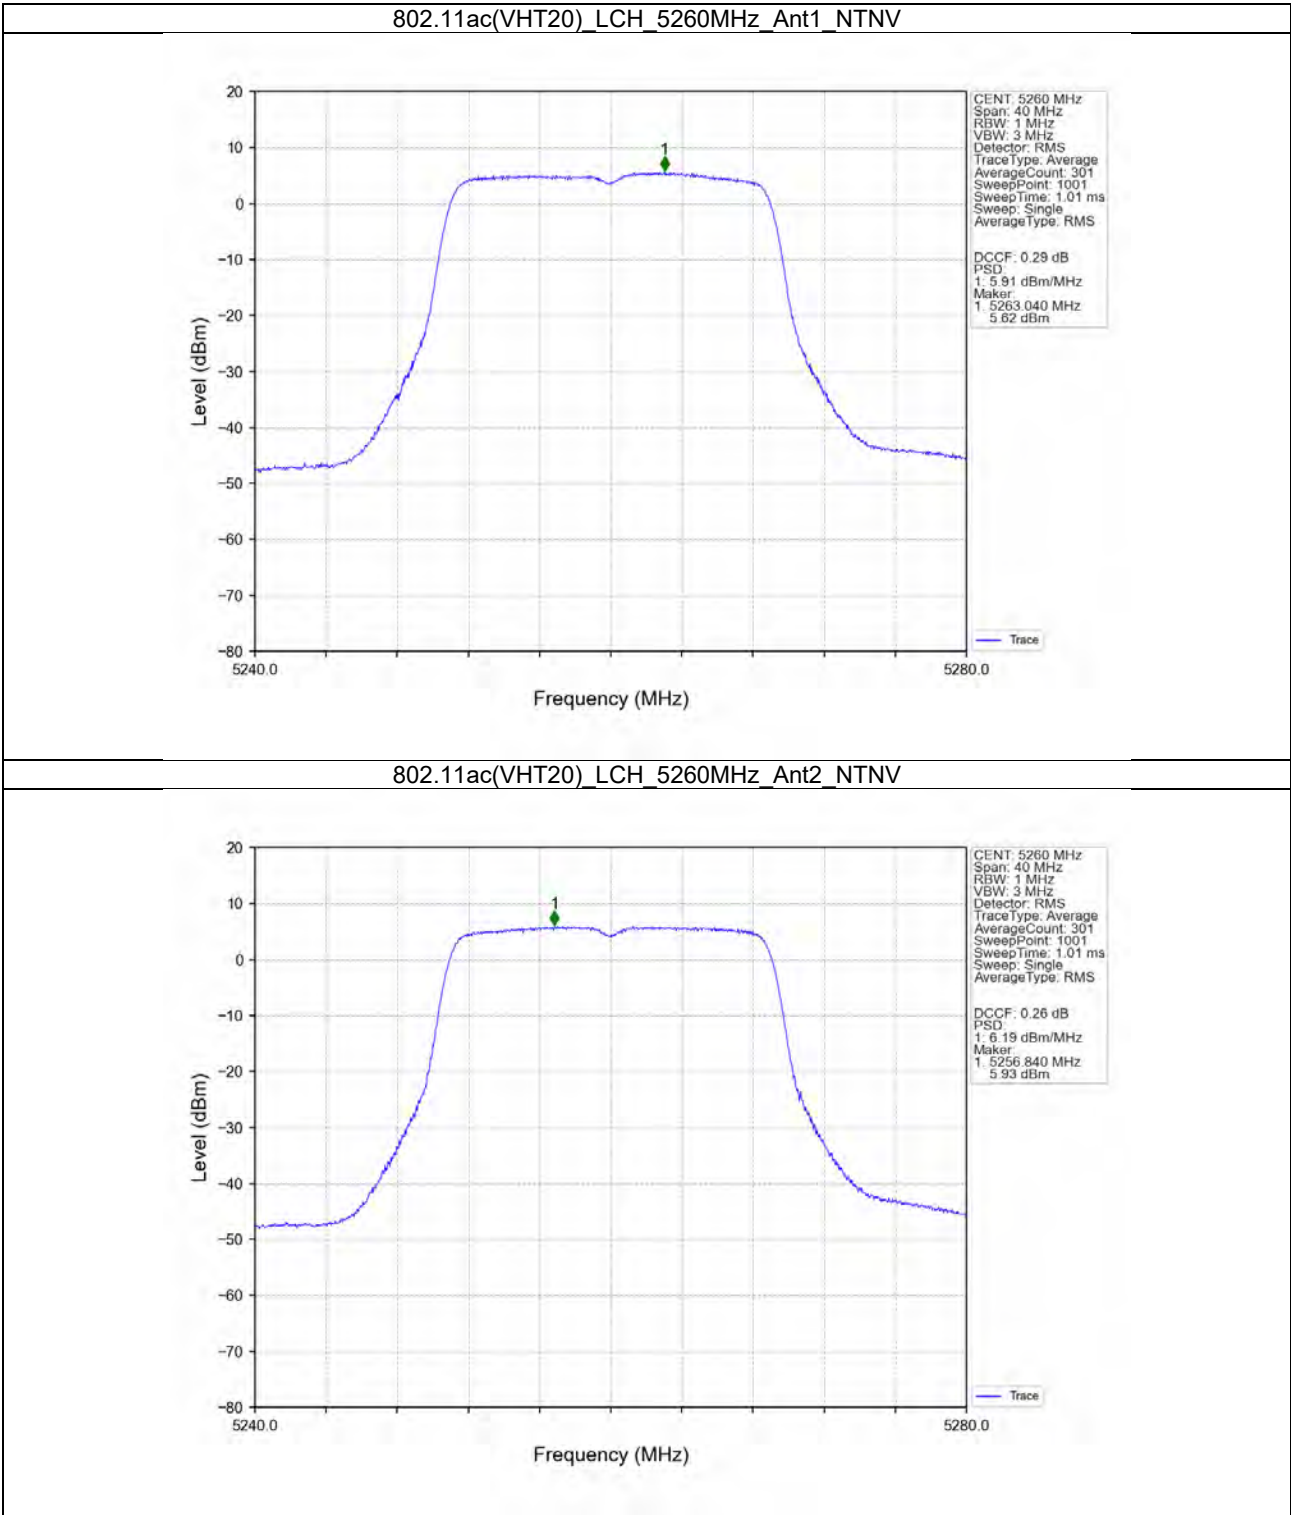



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 370 of 1085

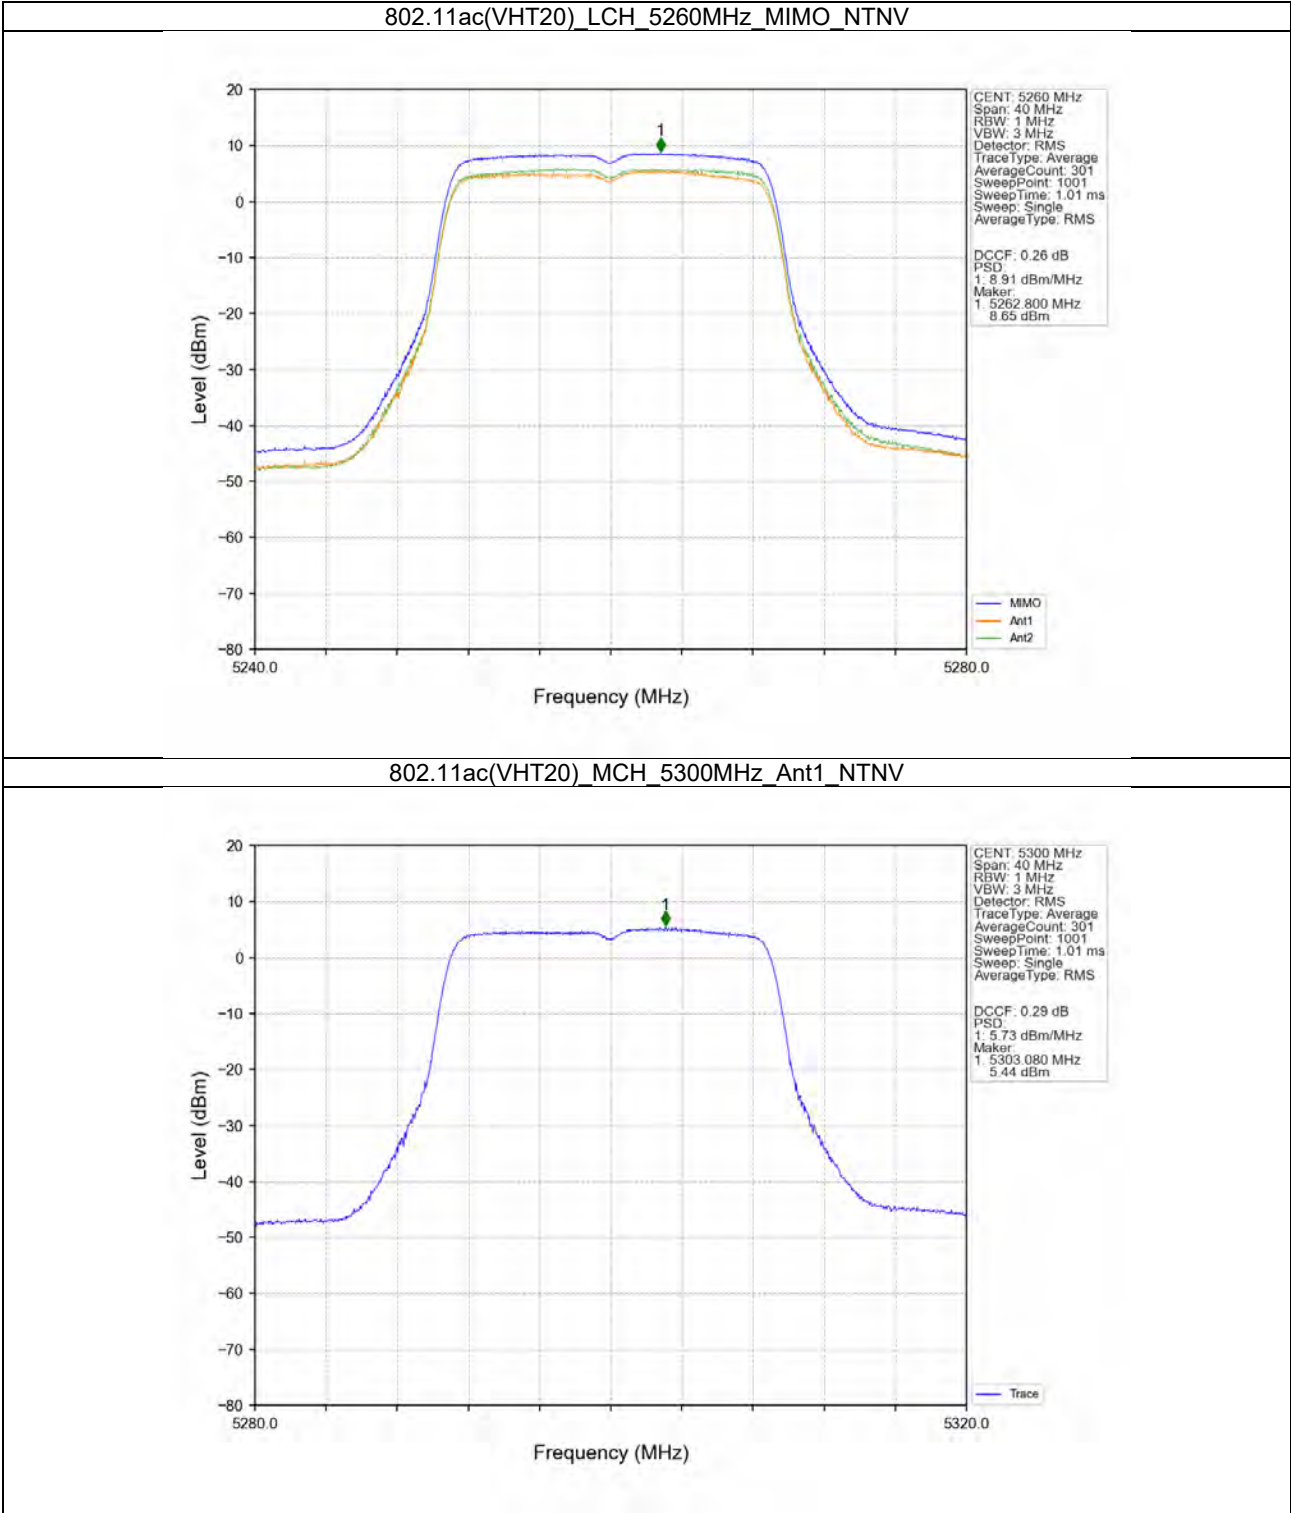



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 371 of 1085

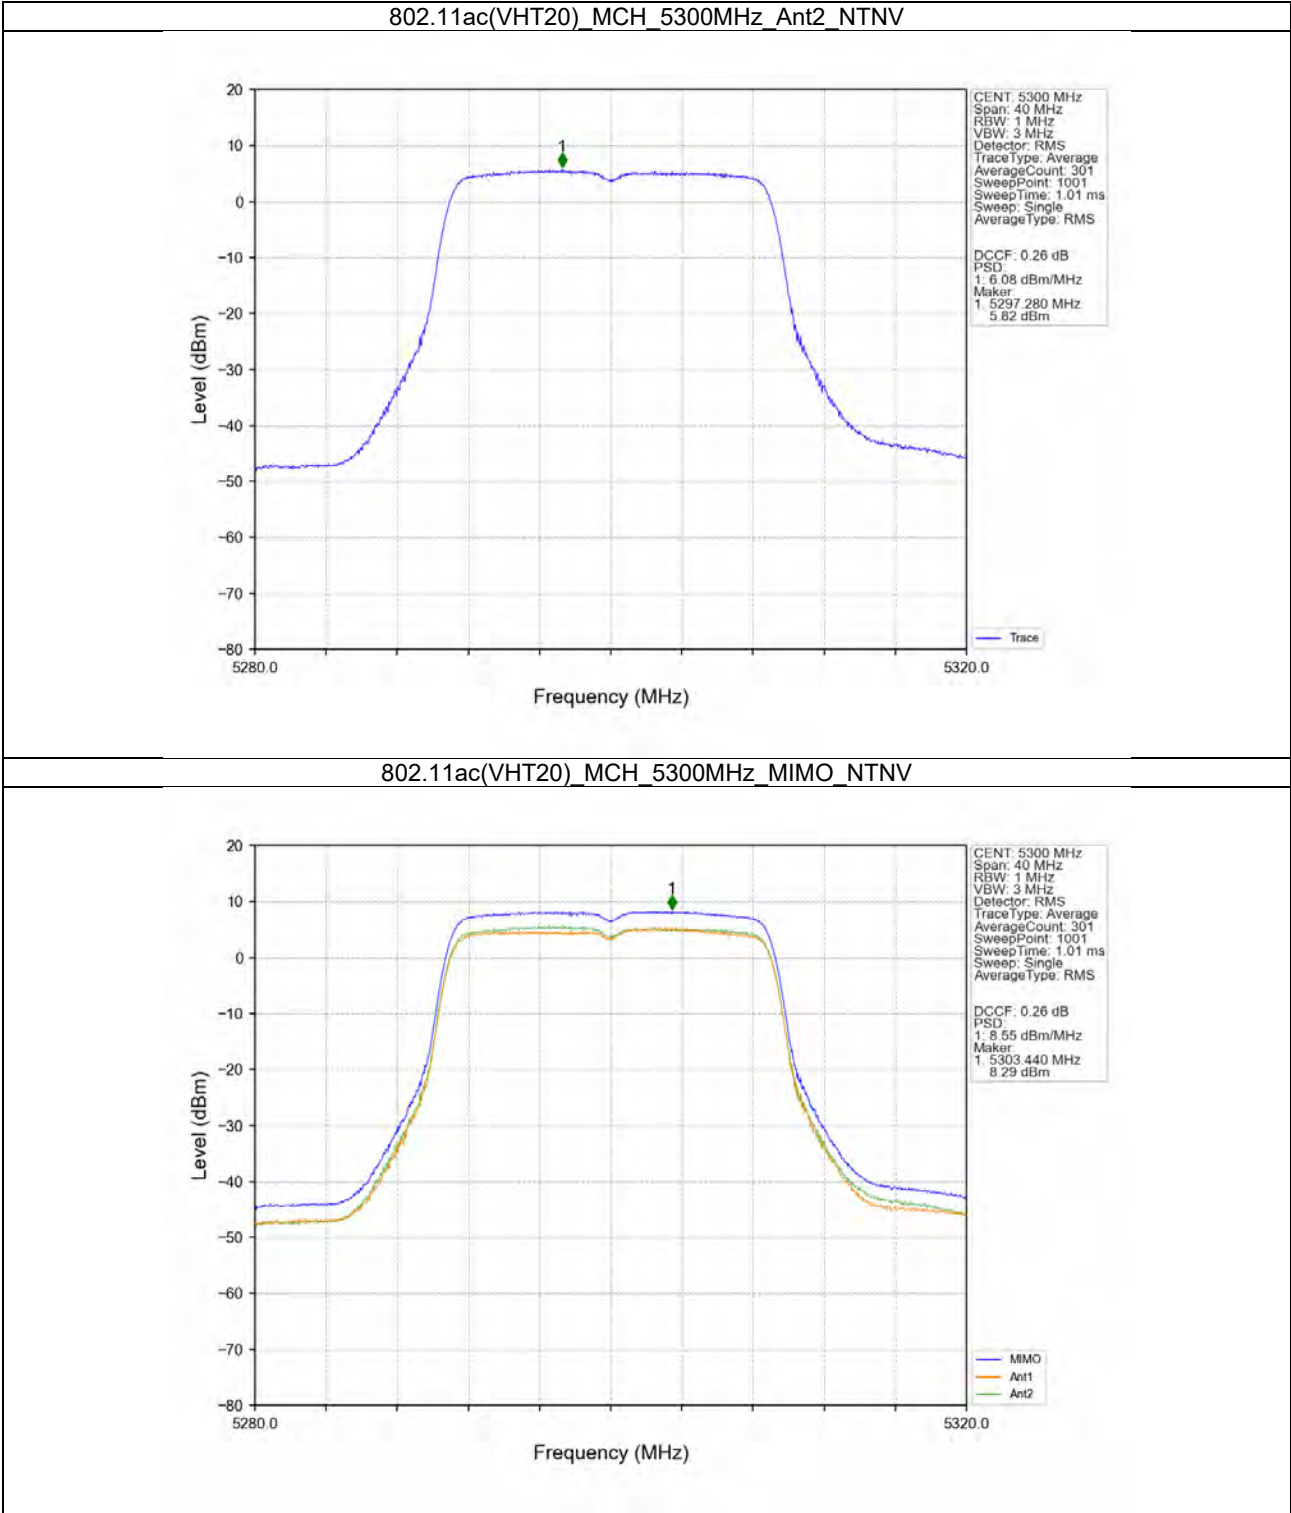




SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 372 of 1085

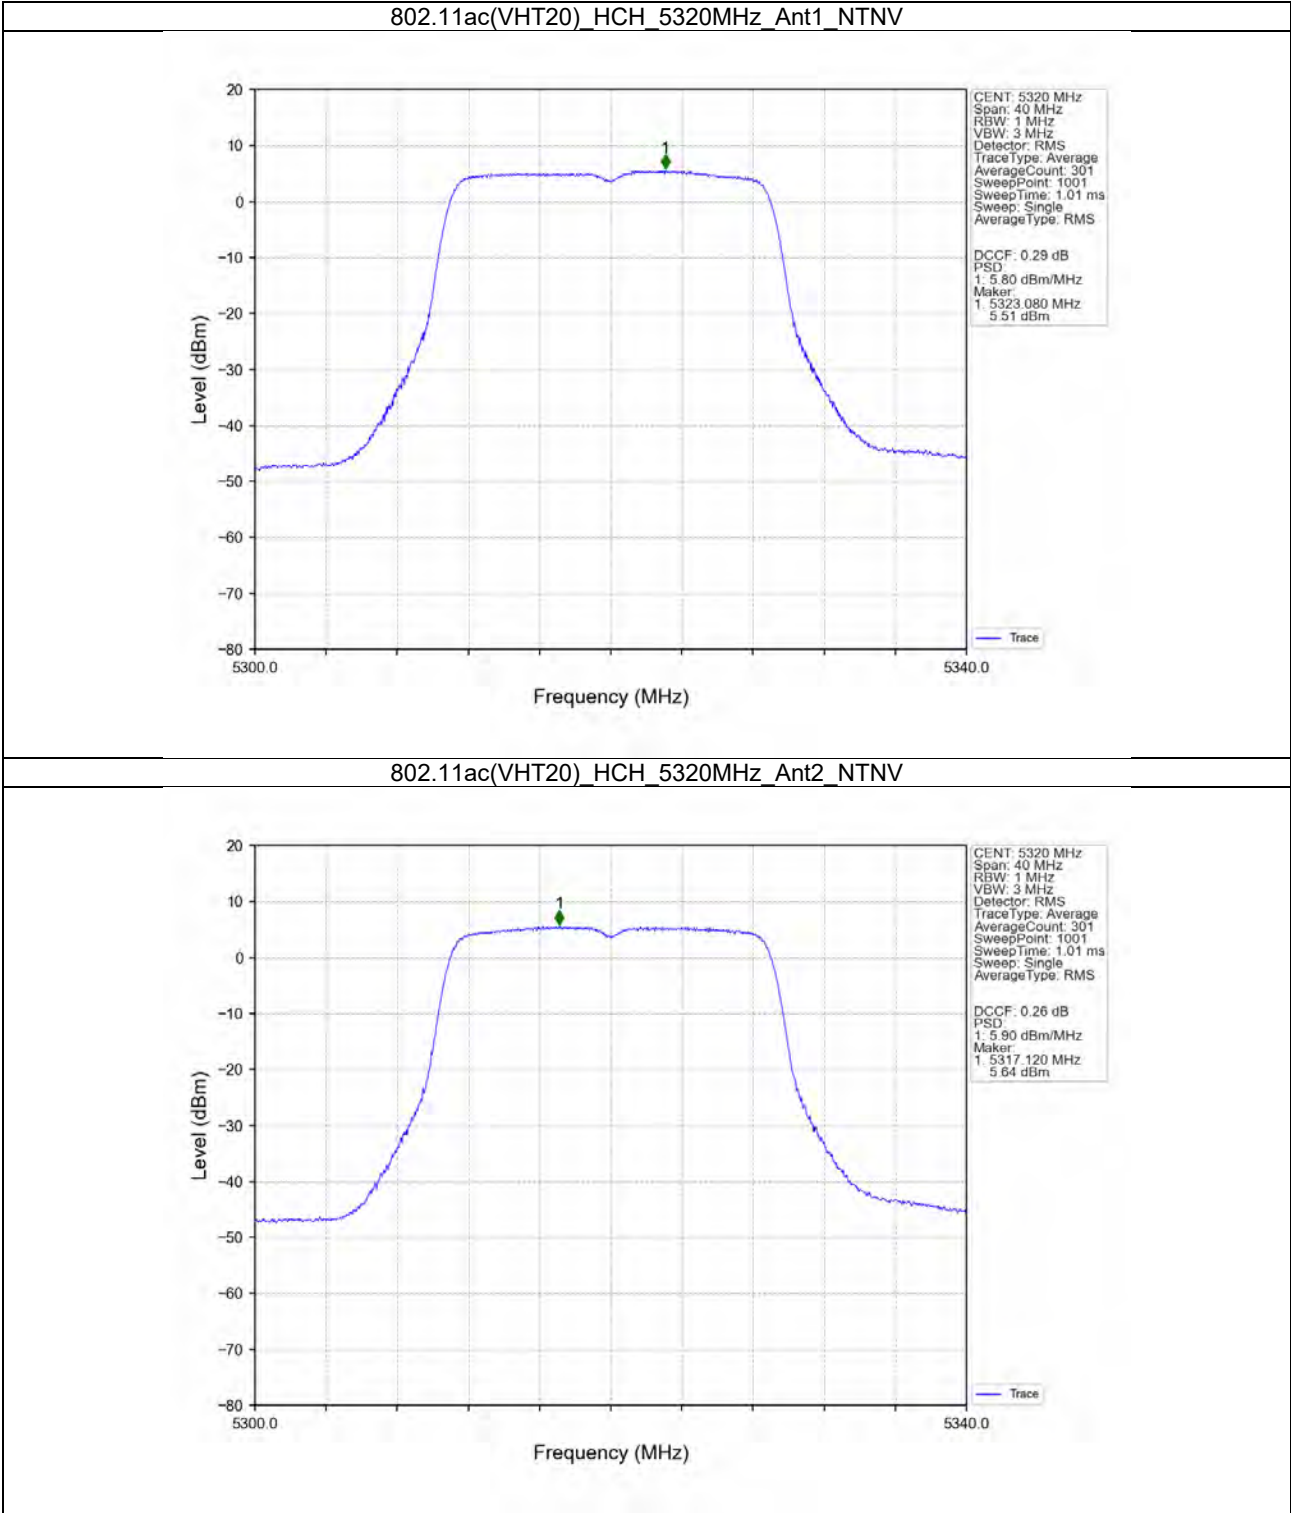

802.11ac(VHT20)_HCH_5320MHz_MIMO_NTNV

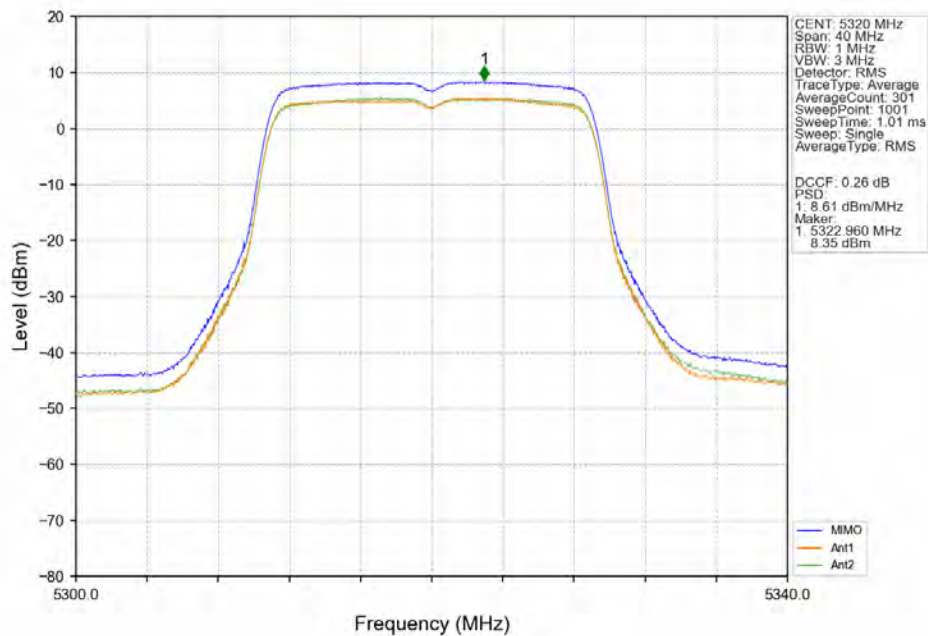


802.11ac(VHT20)_LCH_5500MHz_Ant1_NTNV

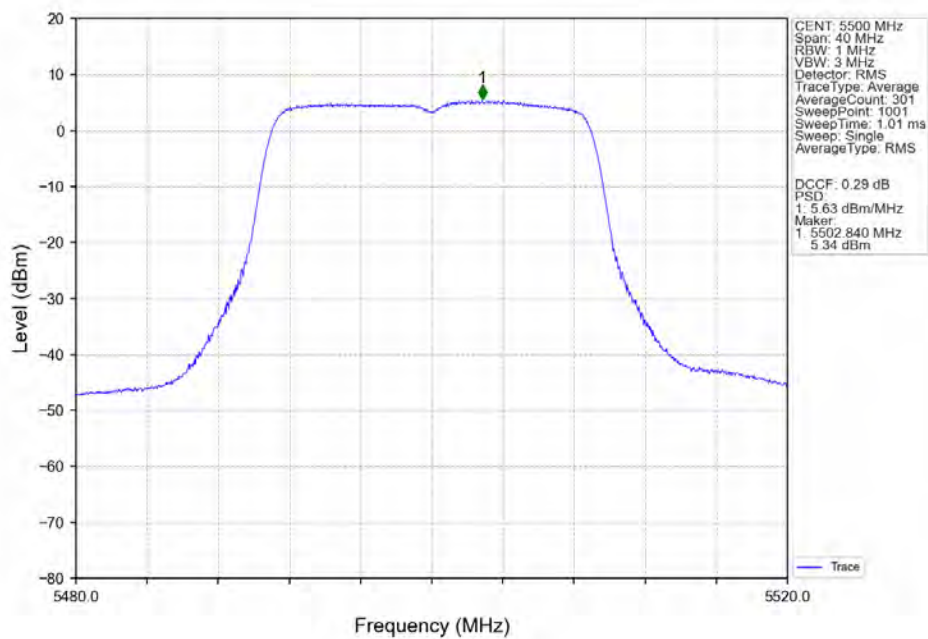



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 374 of 1085

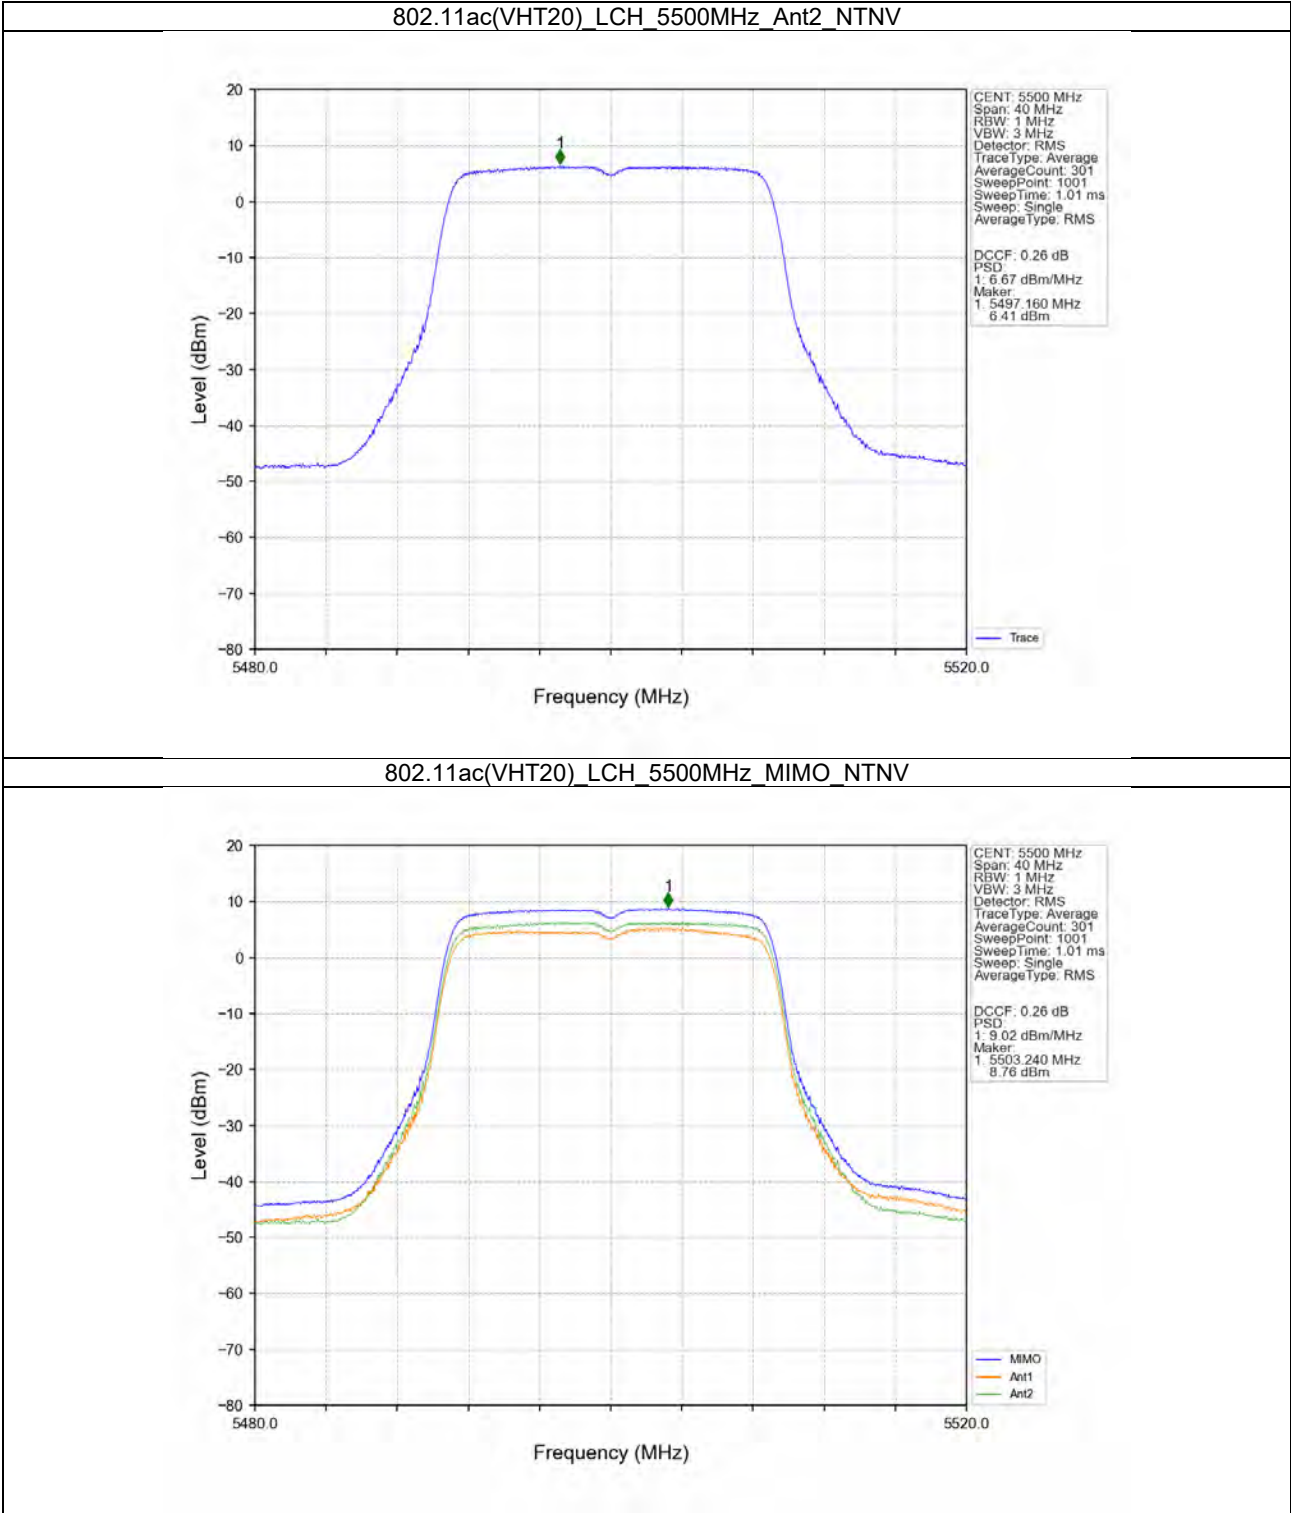



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 375 of 1085

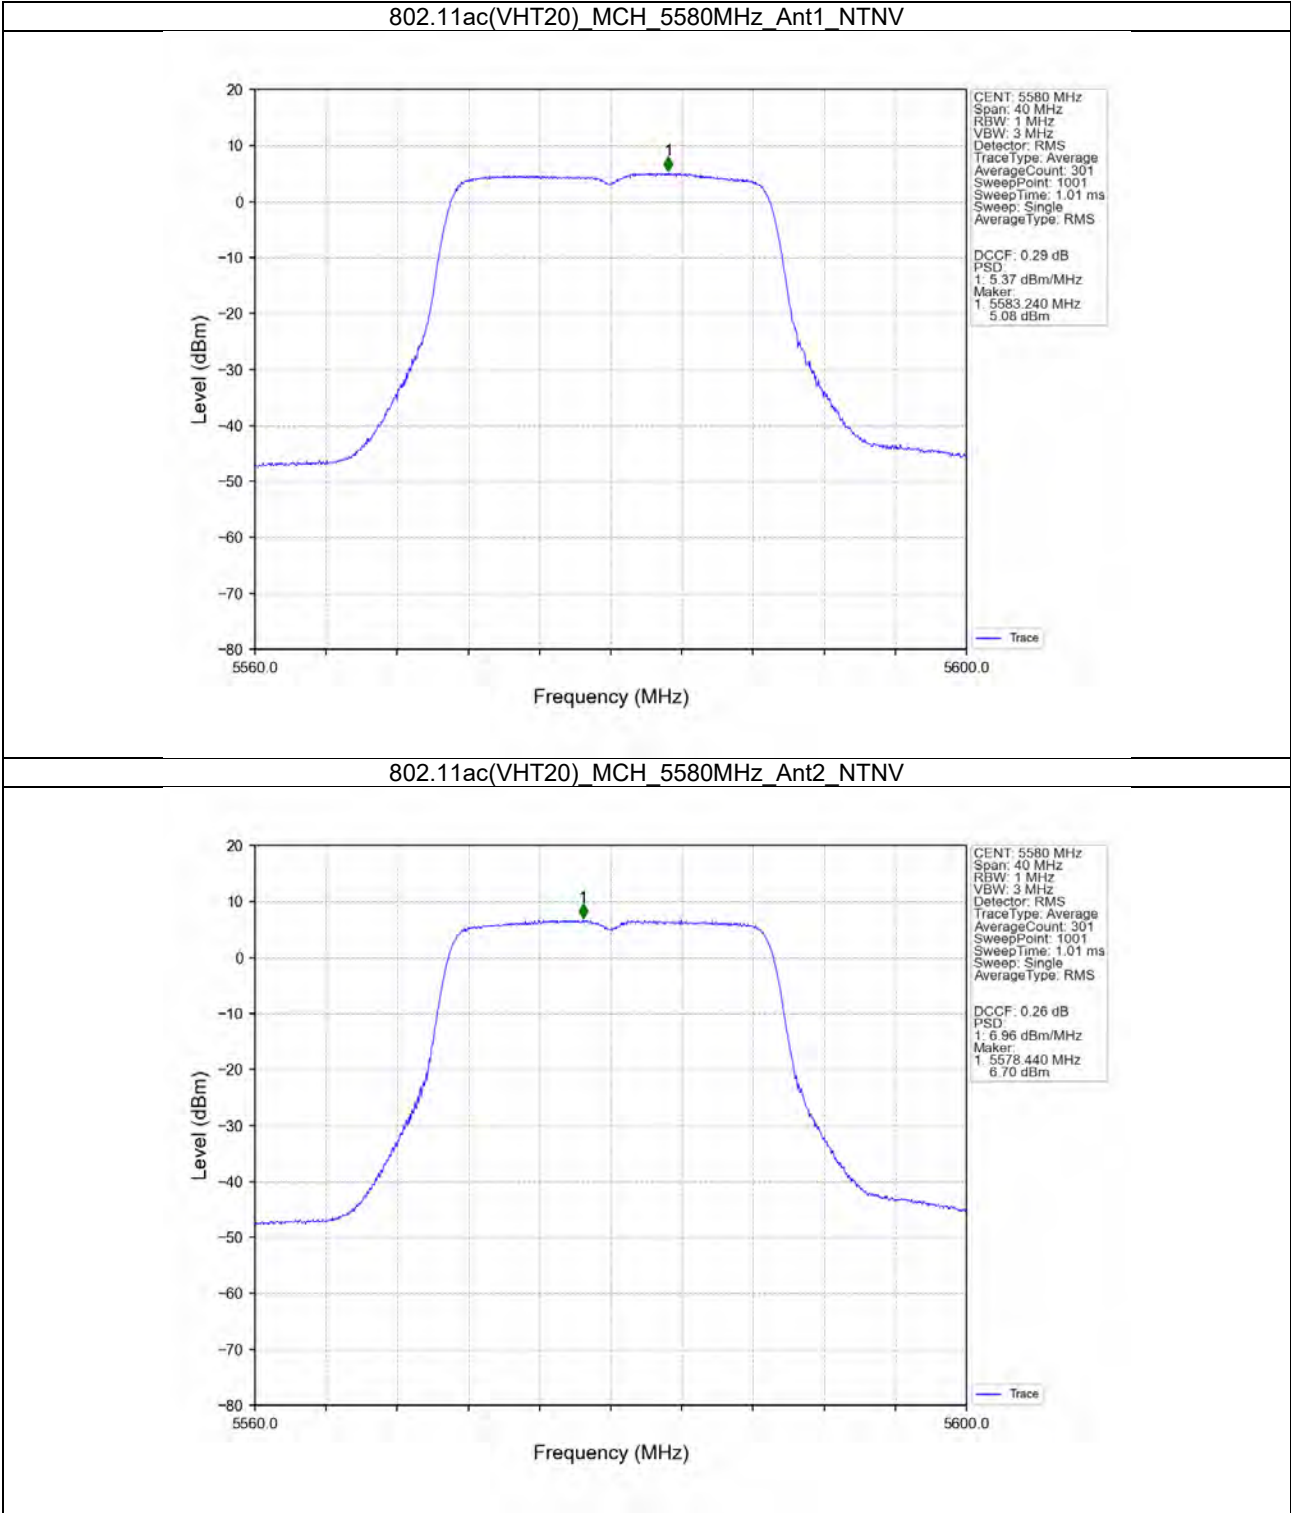



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 376 of 1085

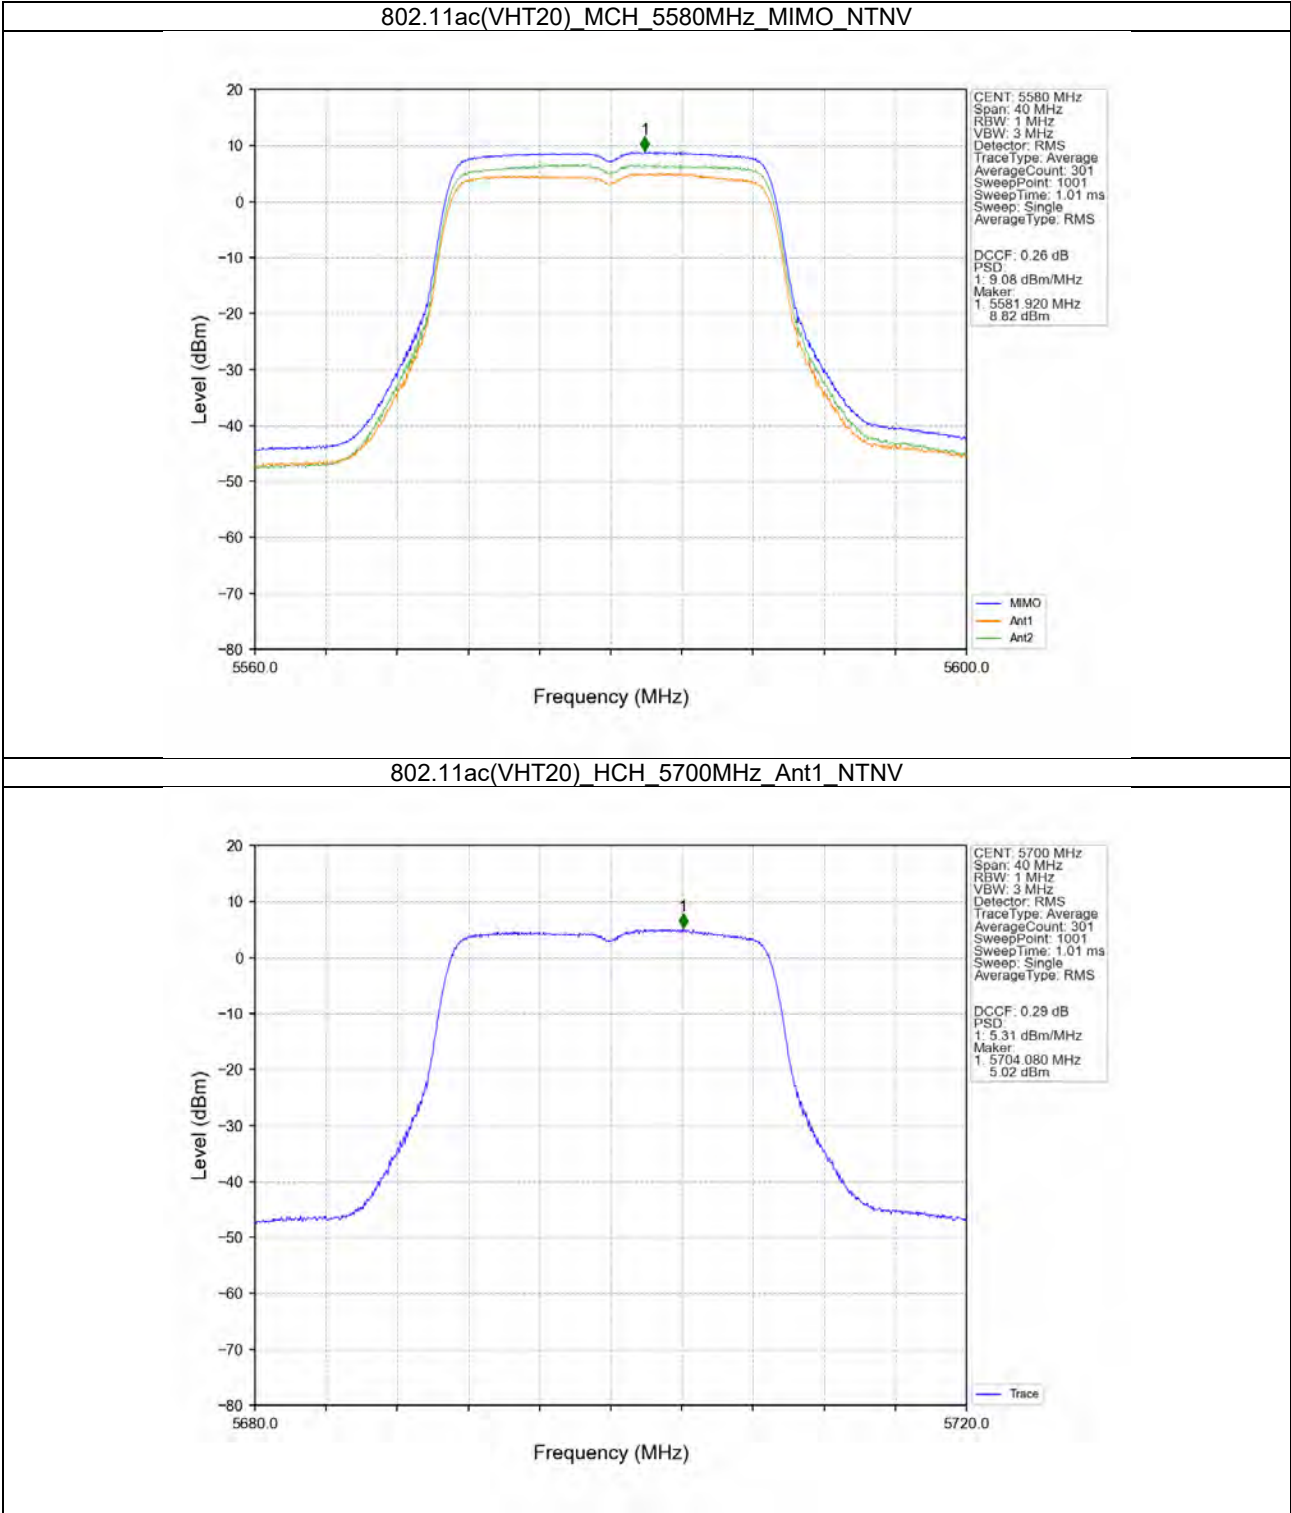



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 377 of 1085

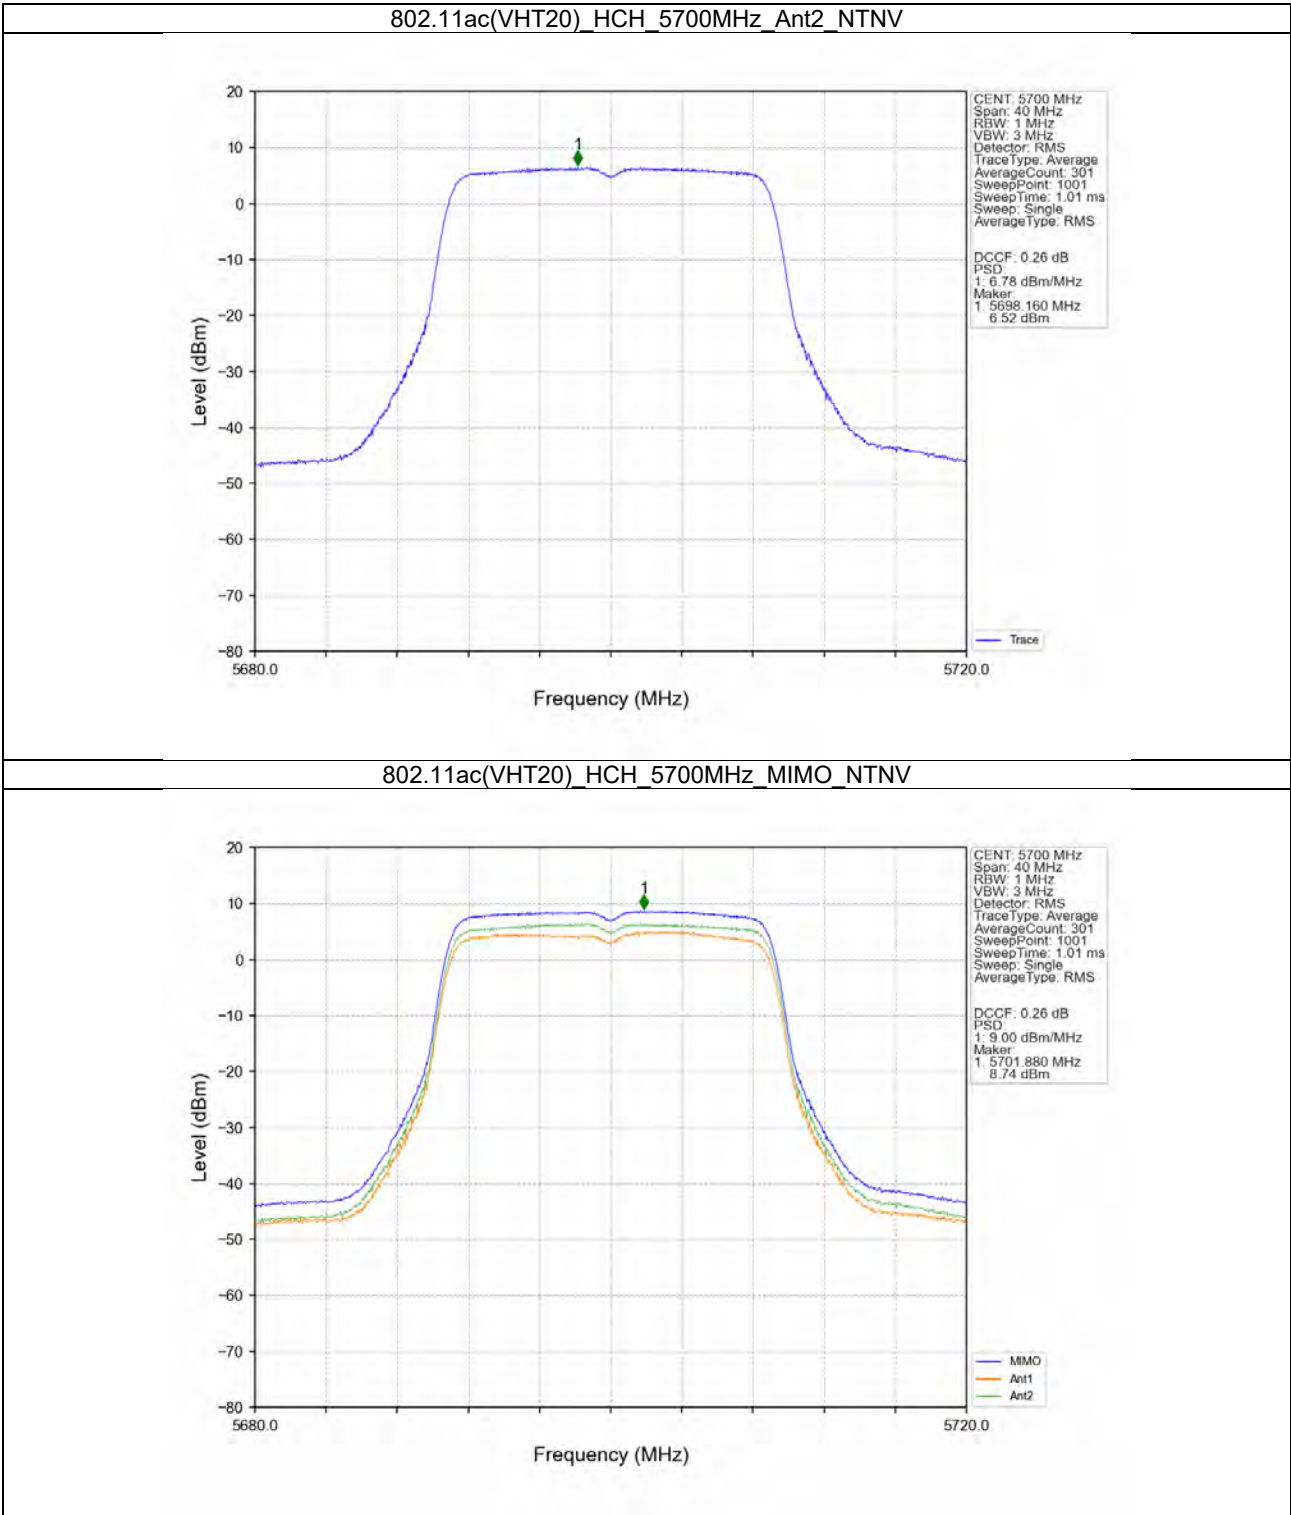



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 378 of 1085

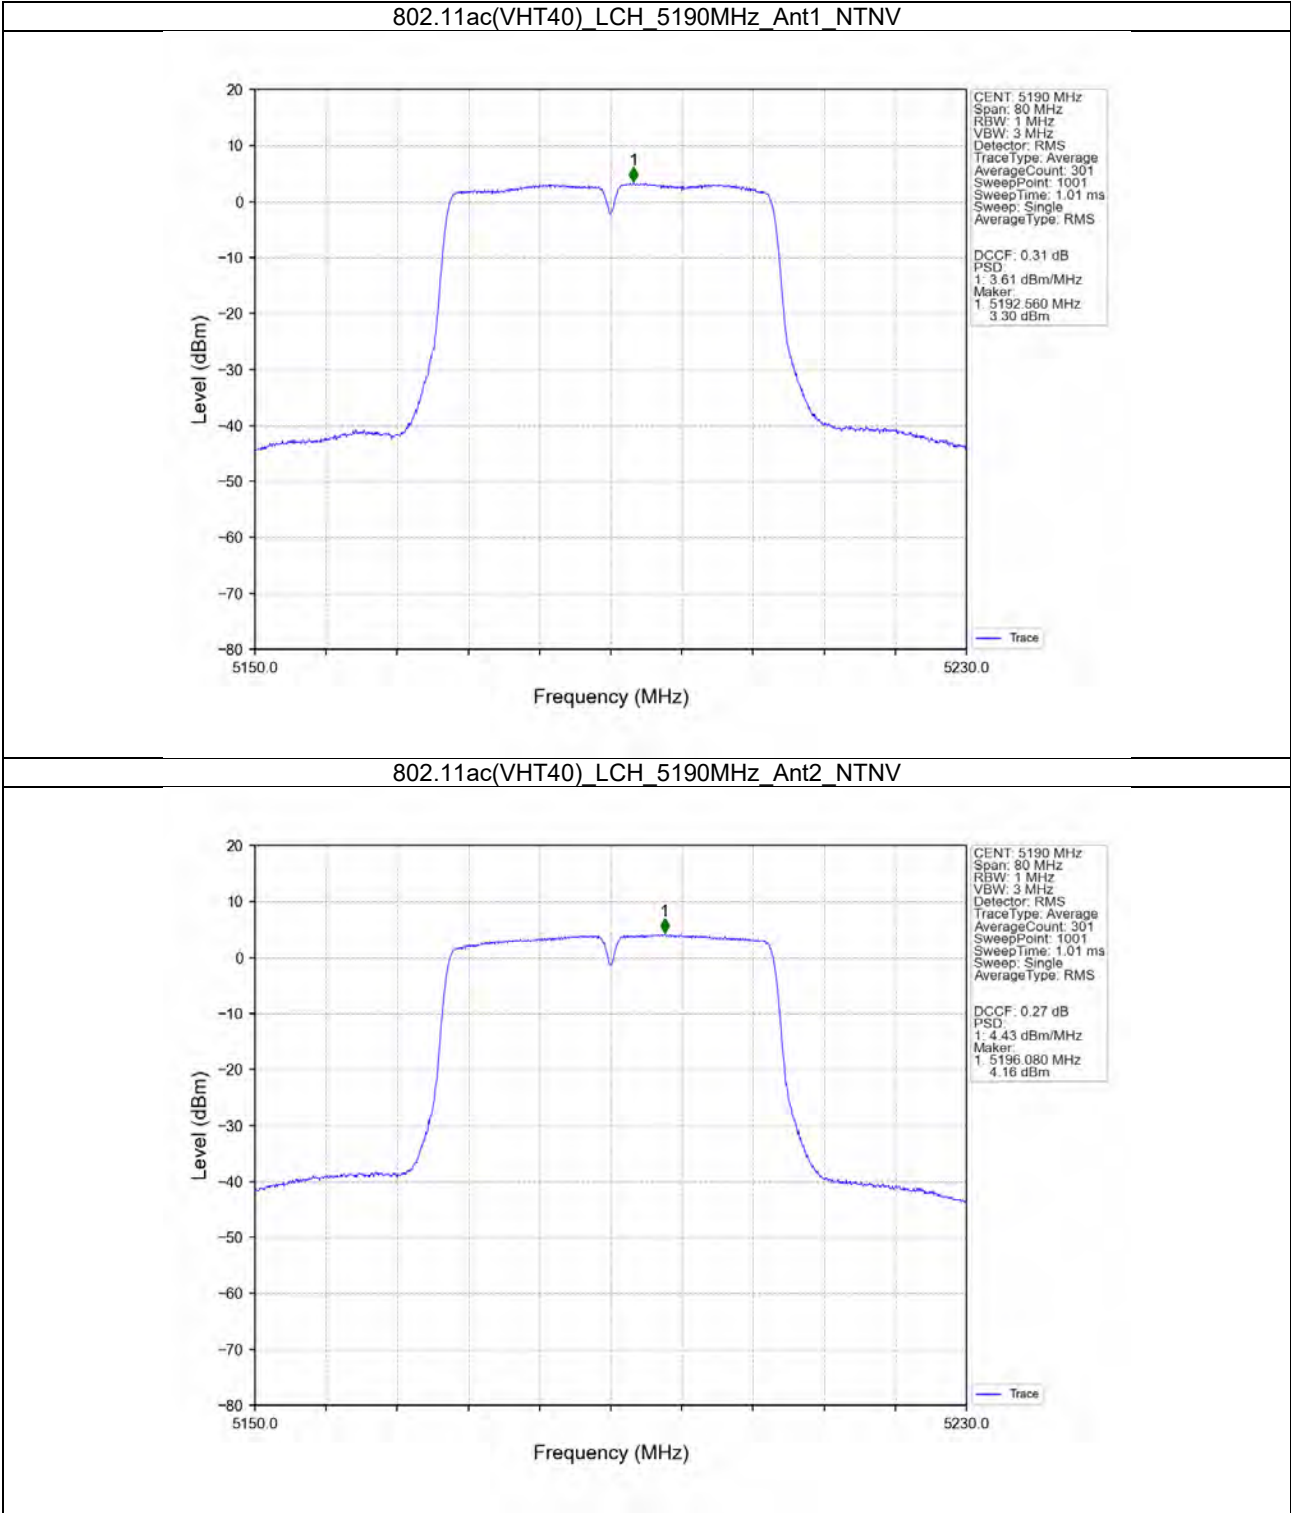



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 379 of 1085

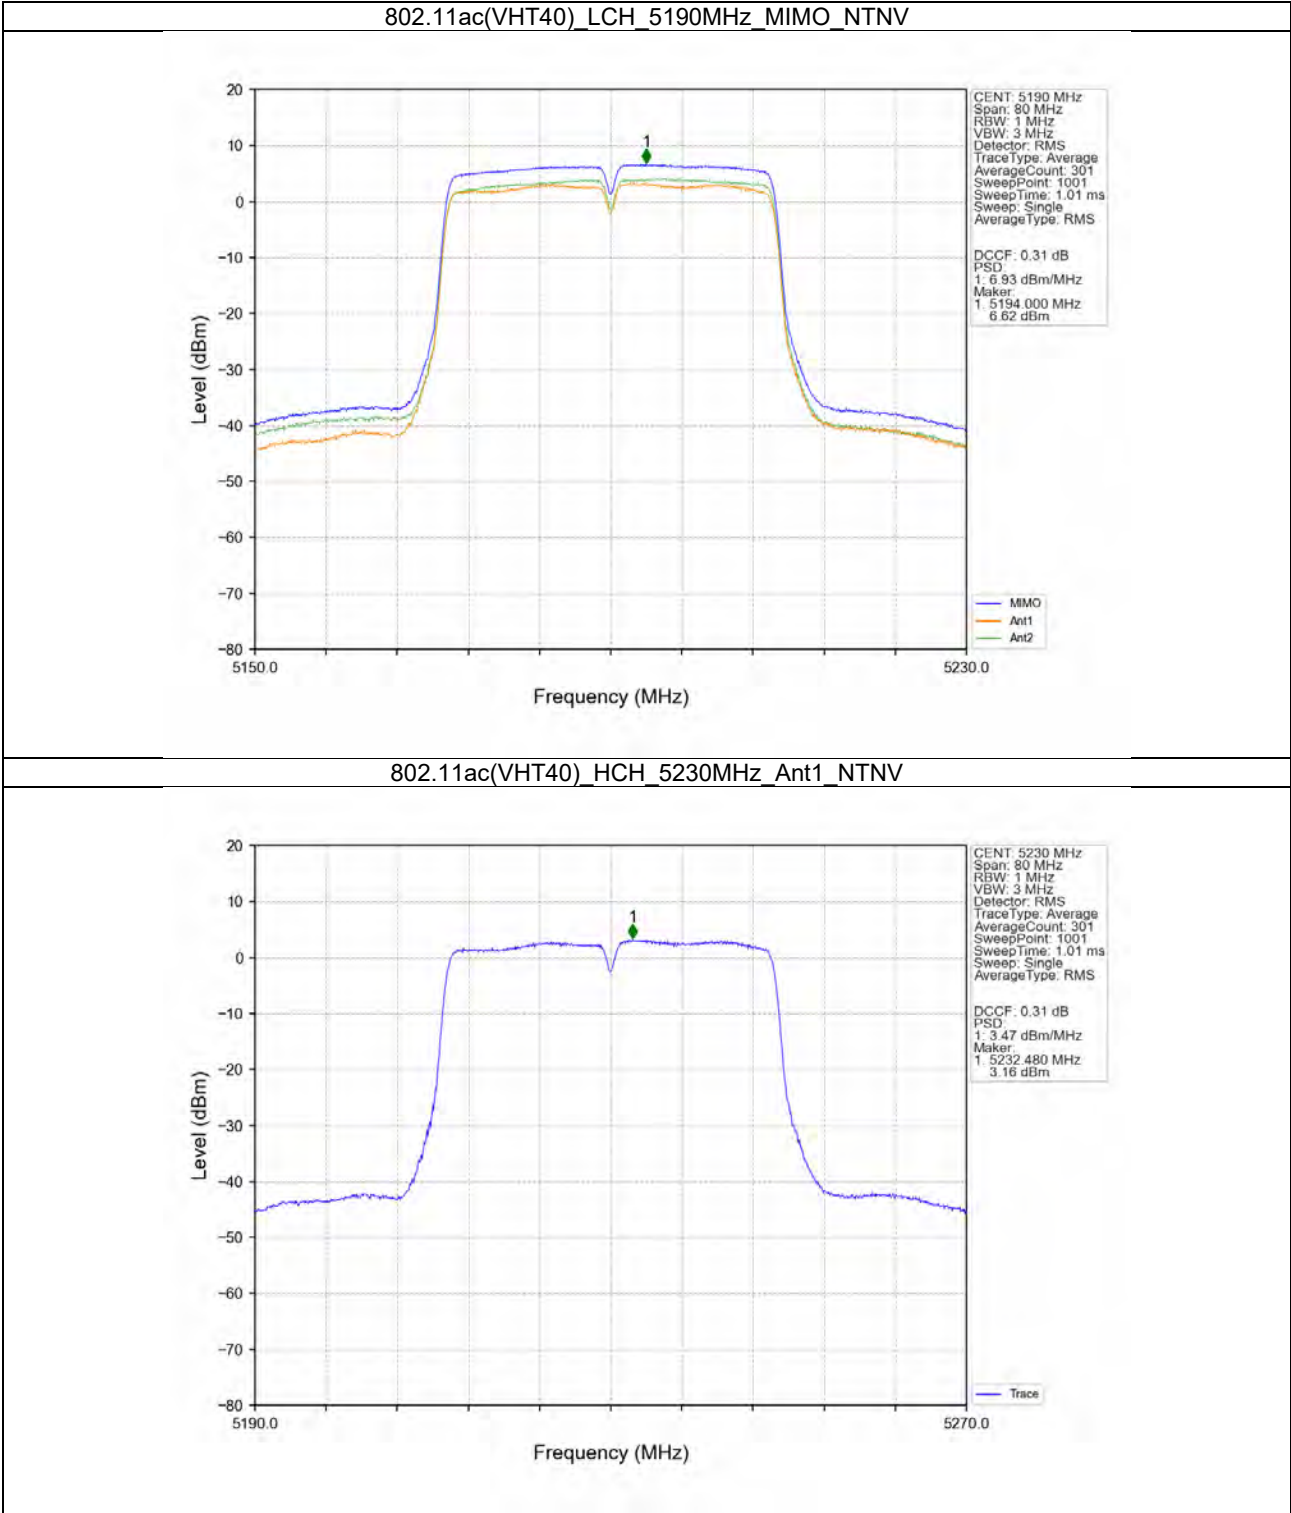



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 380 of 1085

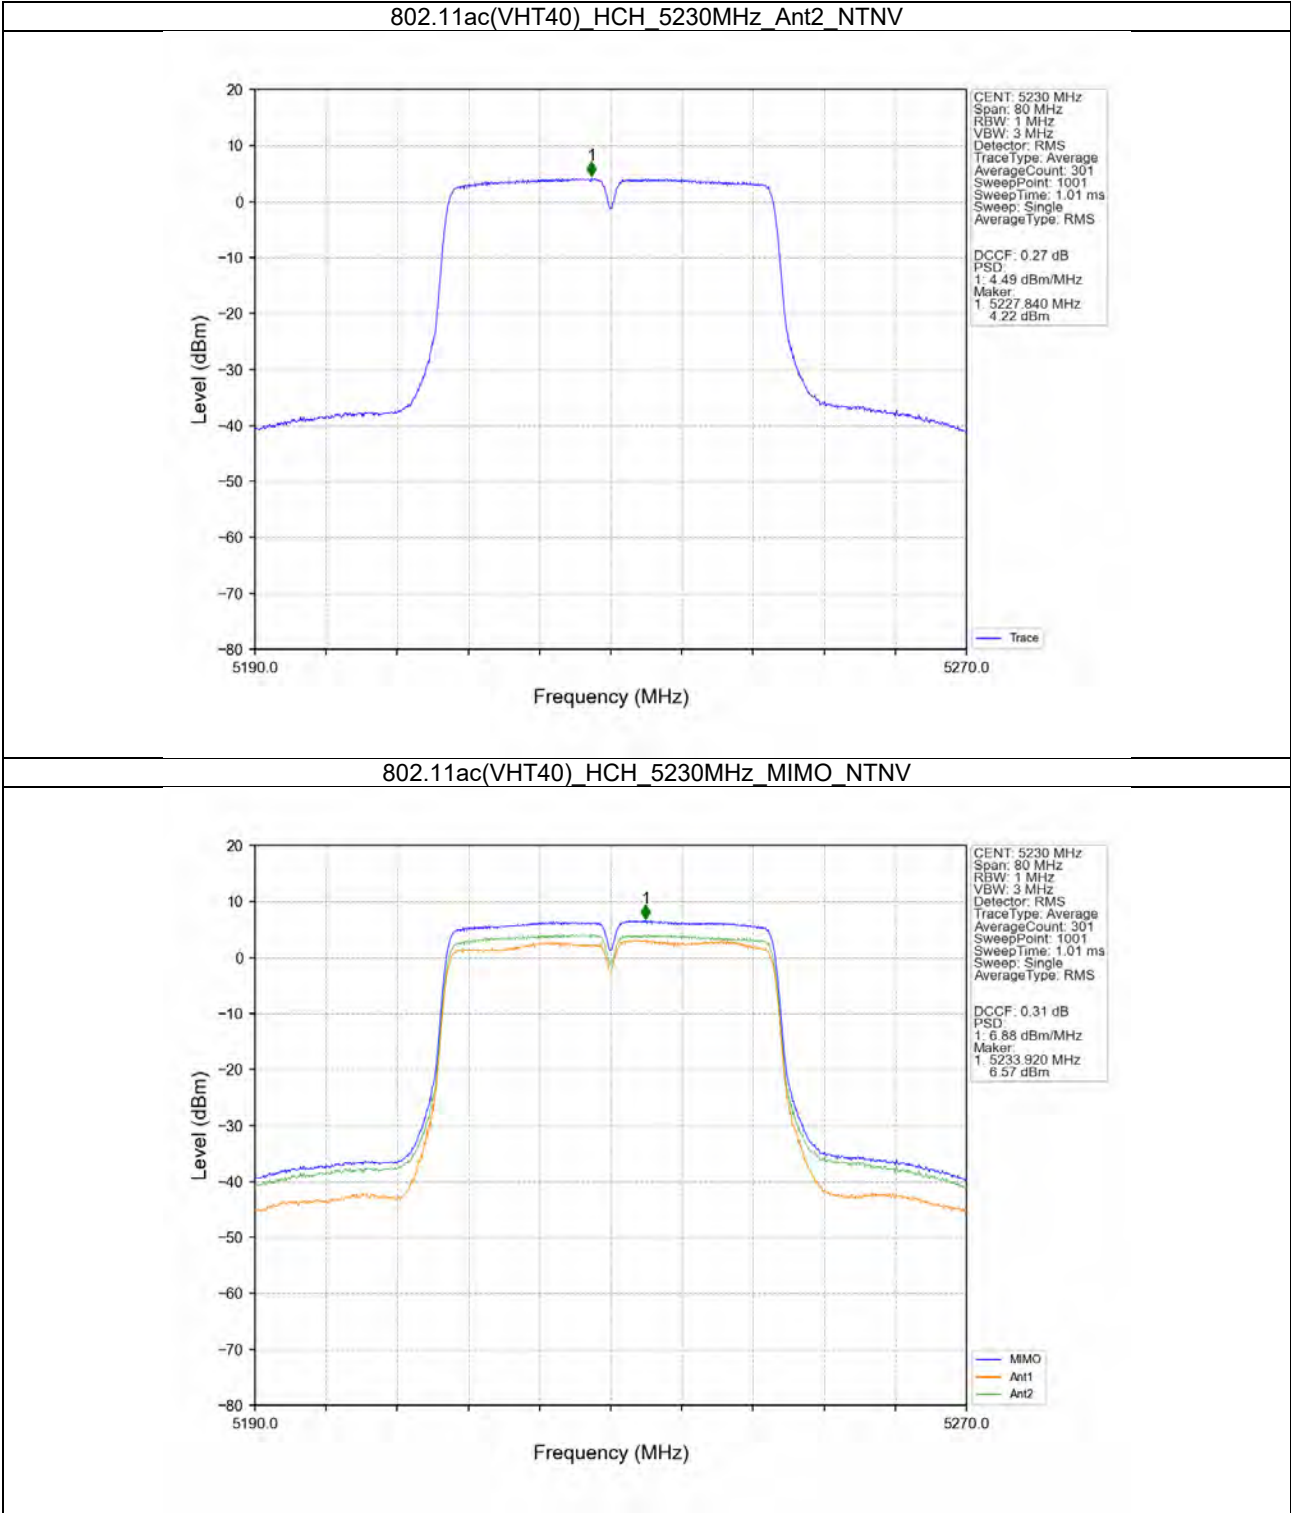




SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 381 of 1085

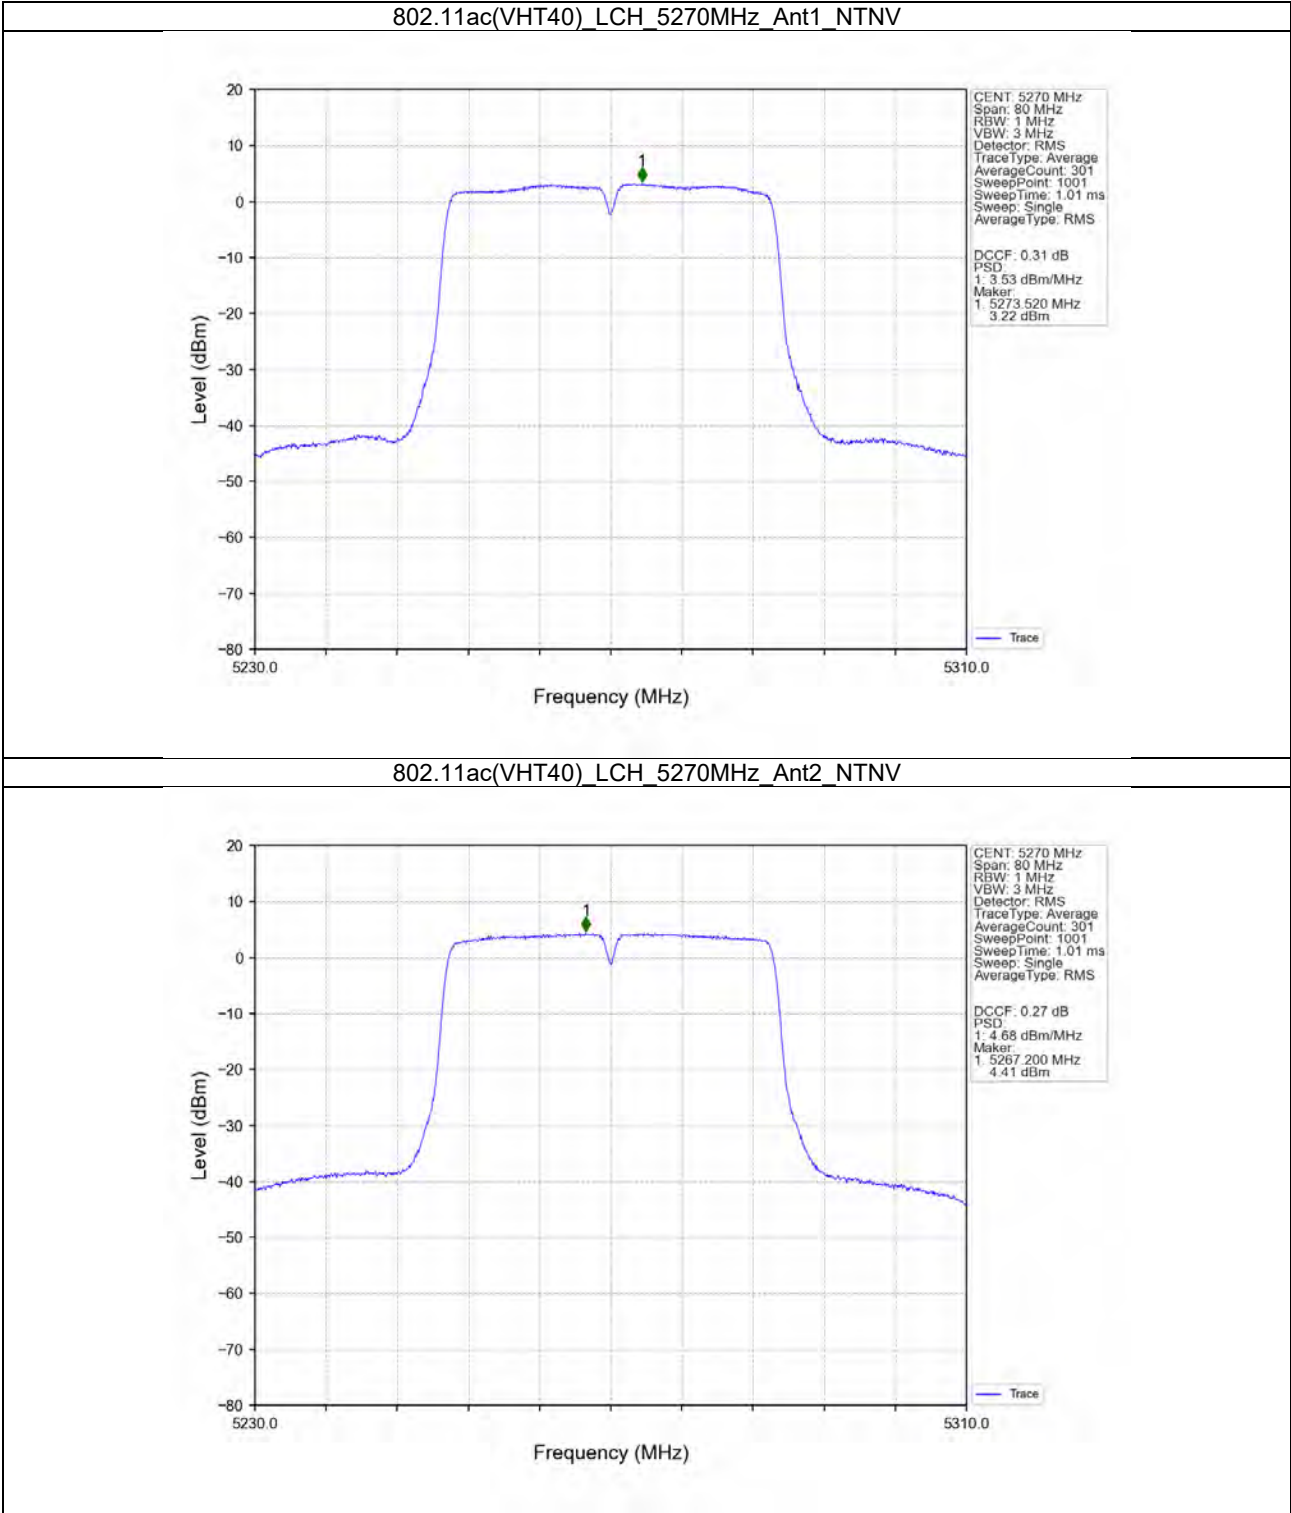


802.11ac(VHT40)_LCH_5270MHz_MIMO_NTNV

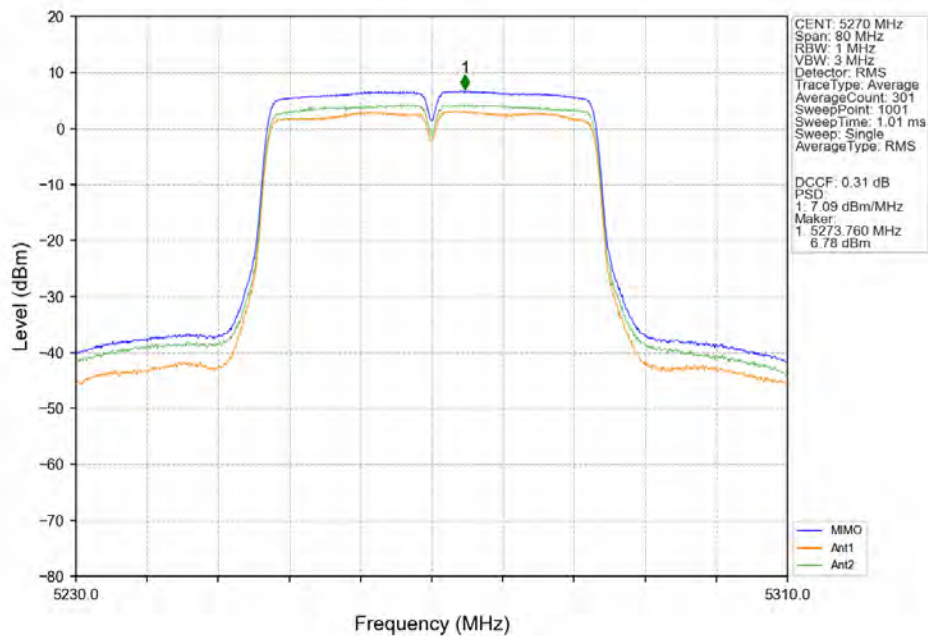


802.11ac(VHT40)_HCH_5310MHz_Ant1_NTNV

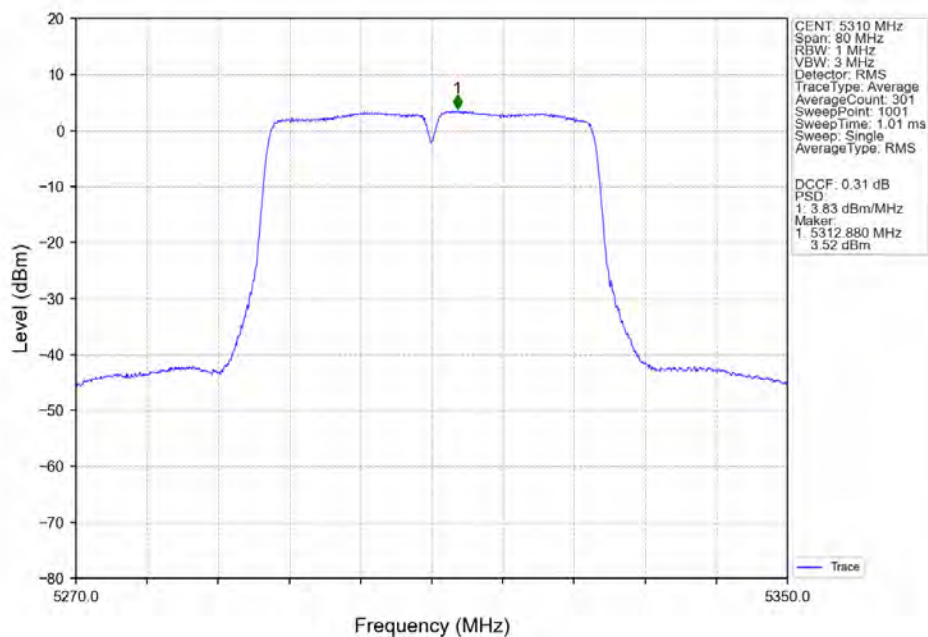

802.11ac(VHT40)_HCH_5310MHz_Ant2_NTNV

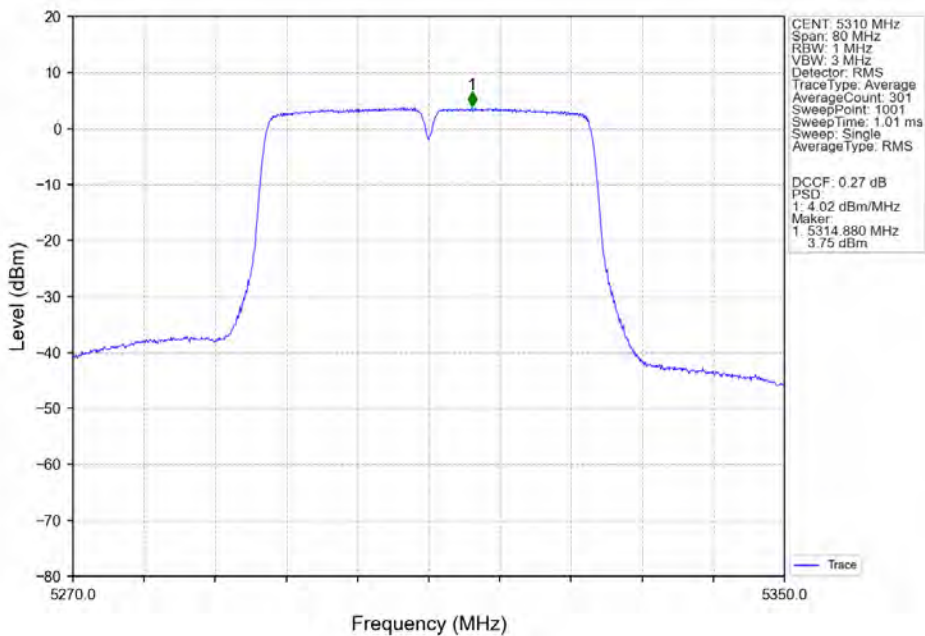


802.11ac(VHT40)_HCH_5310MHz_MIMO_NTNV

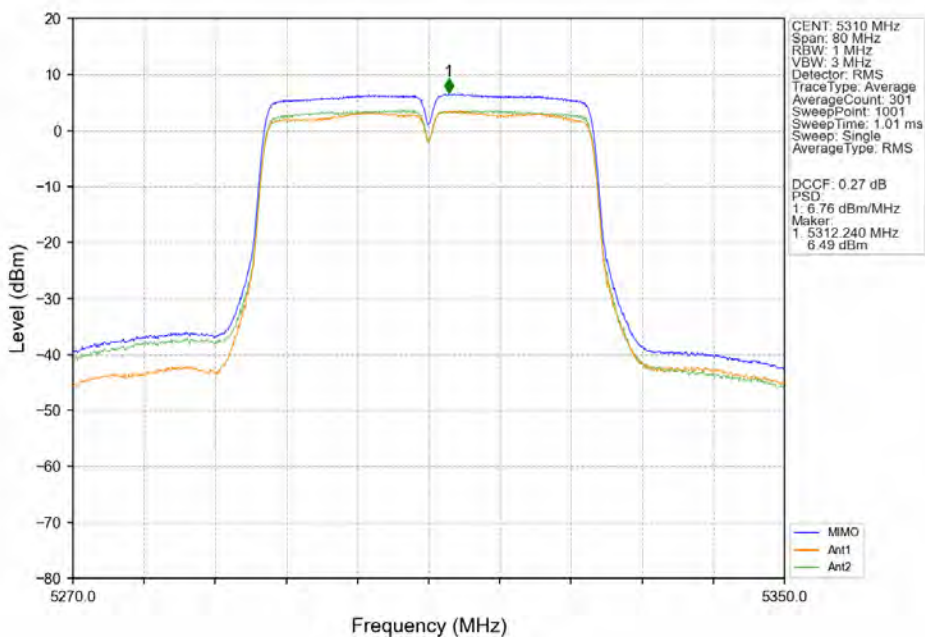



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 384 of 1085

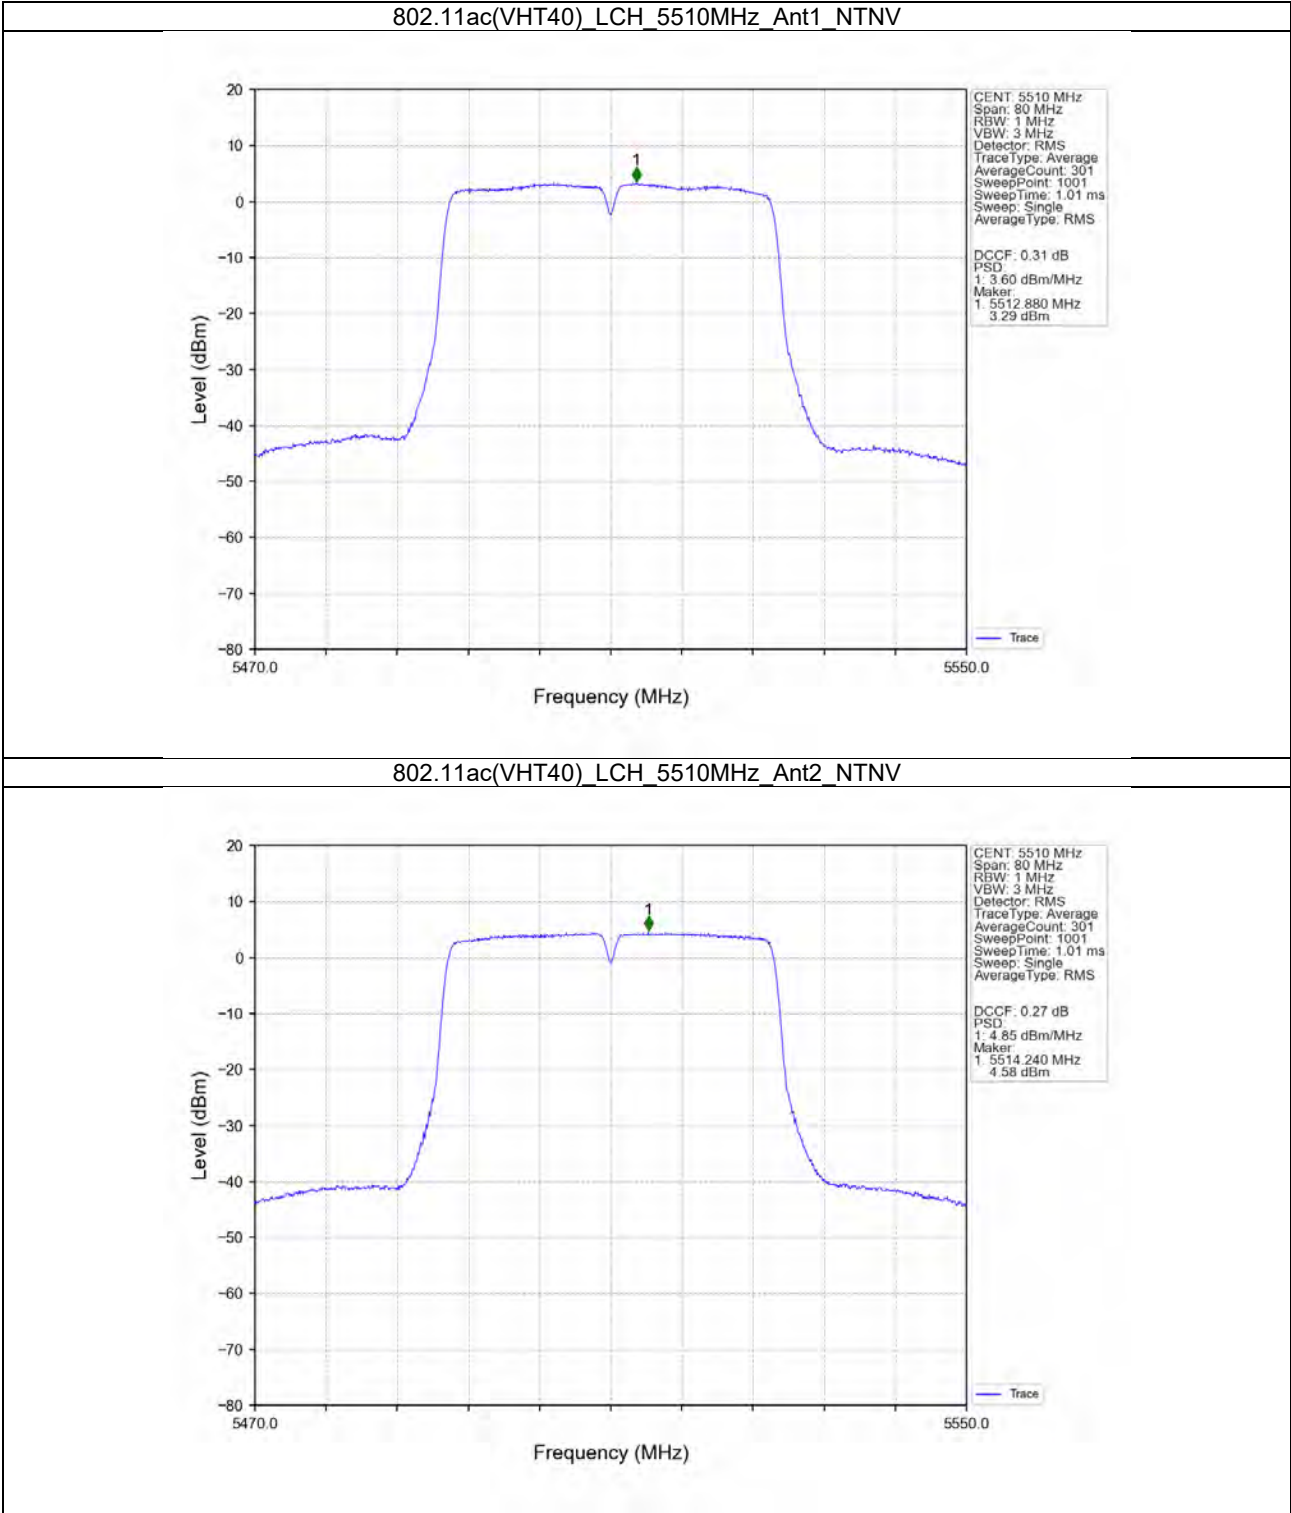



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 385 of 1085

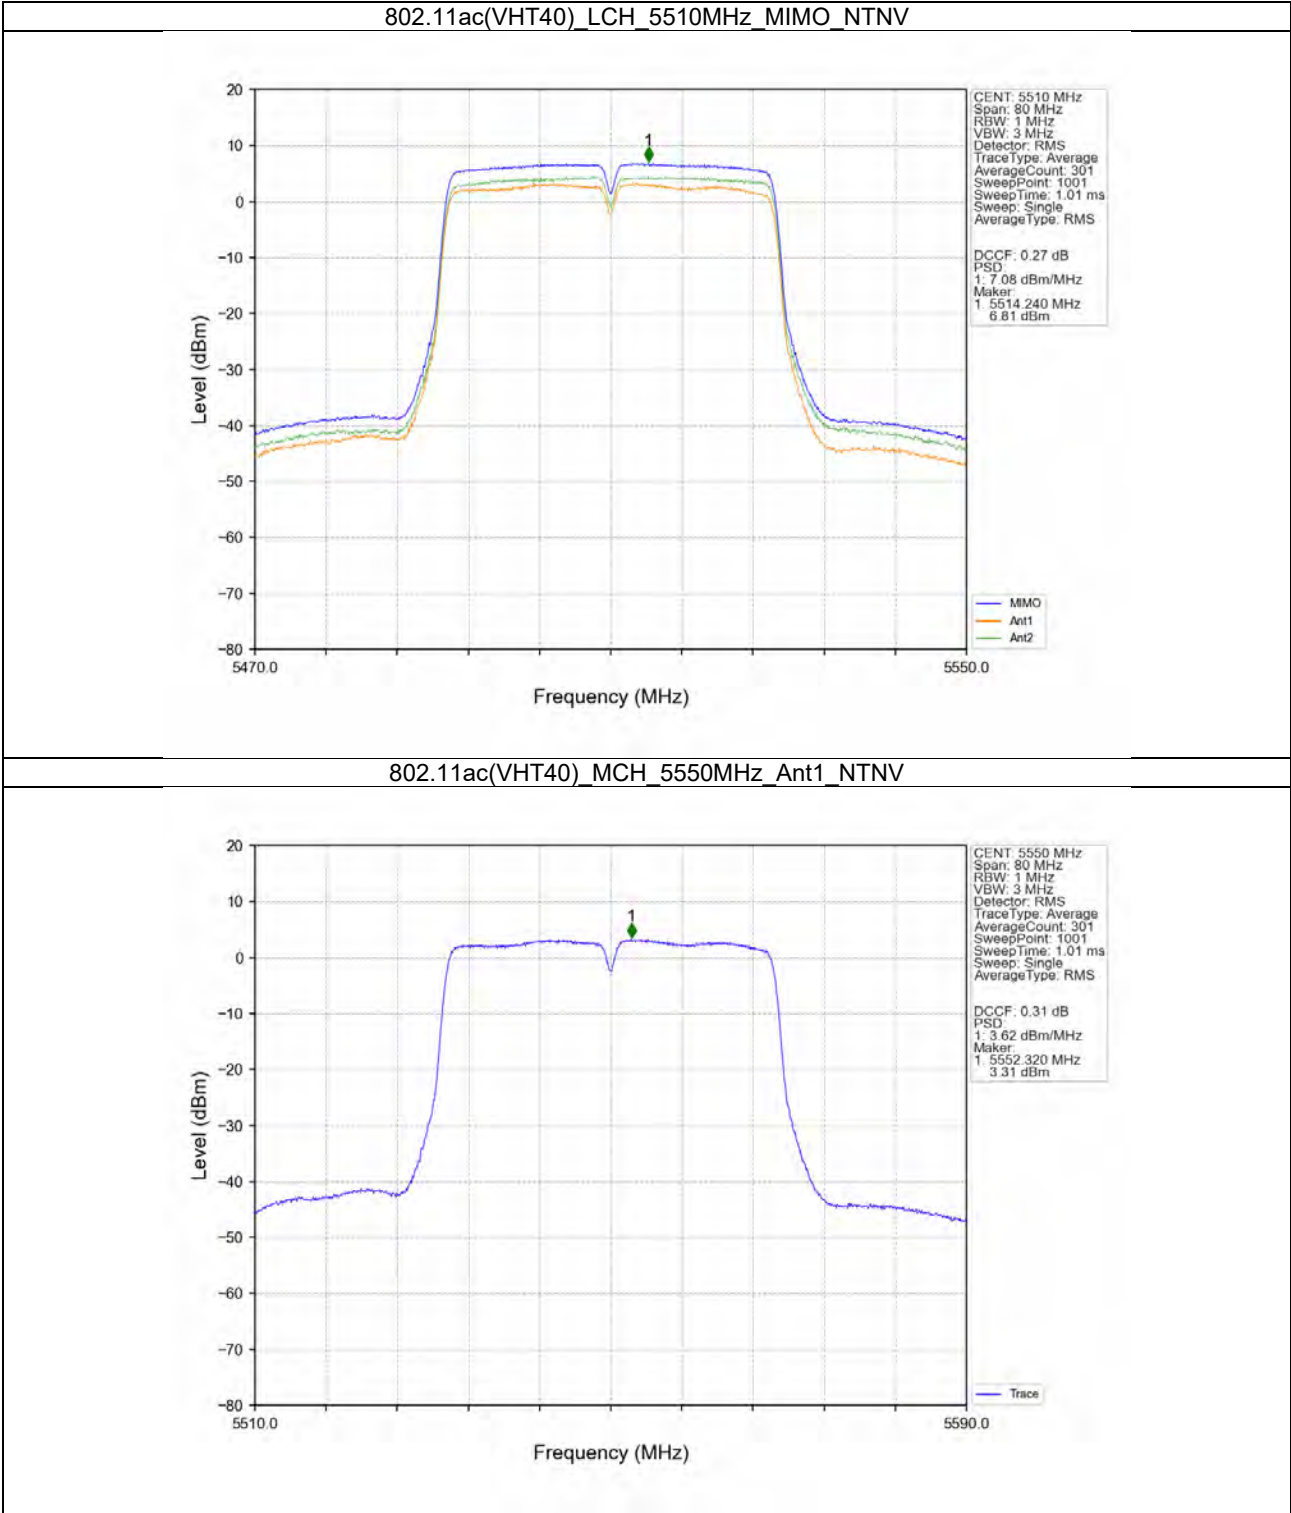



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 386 of 1085

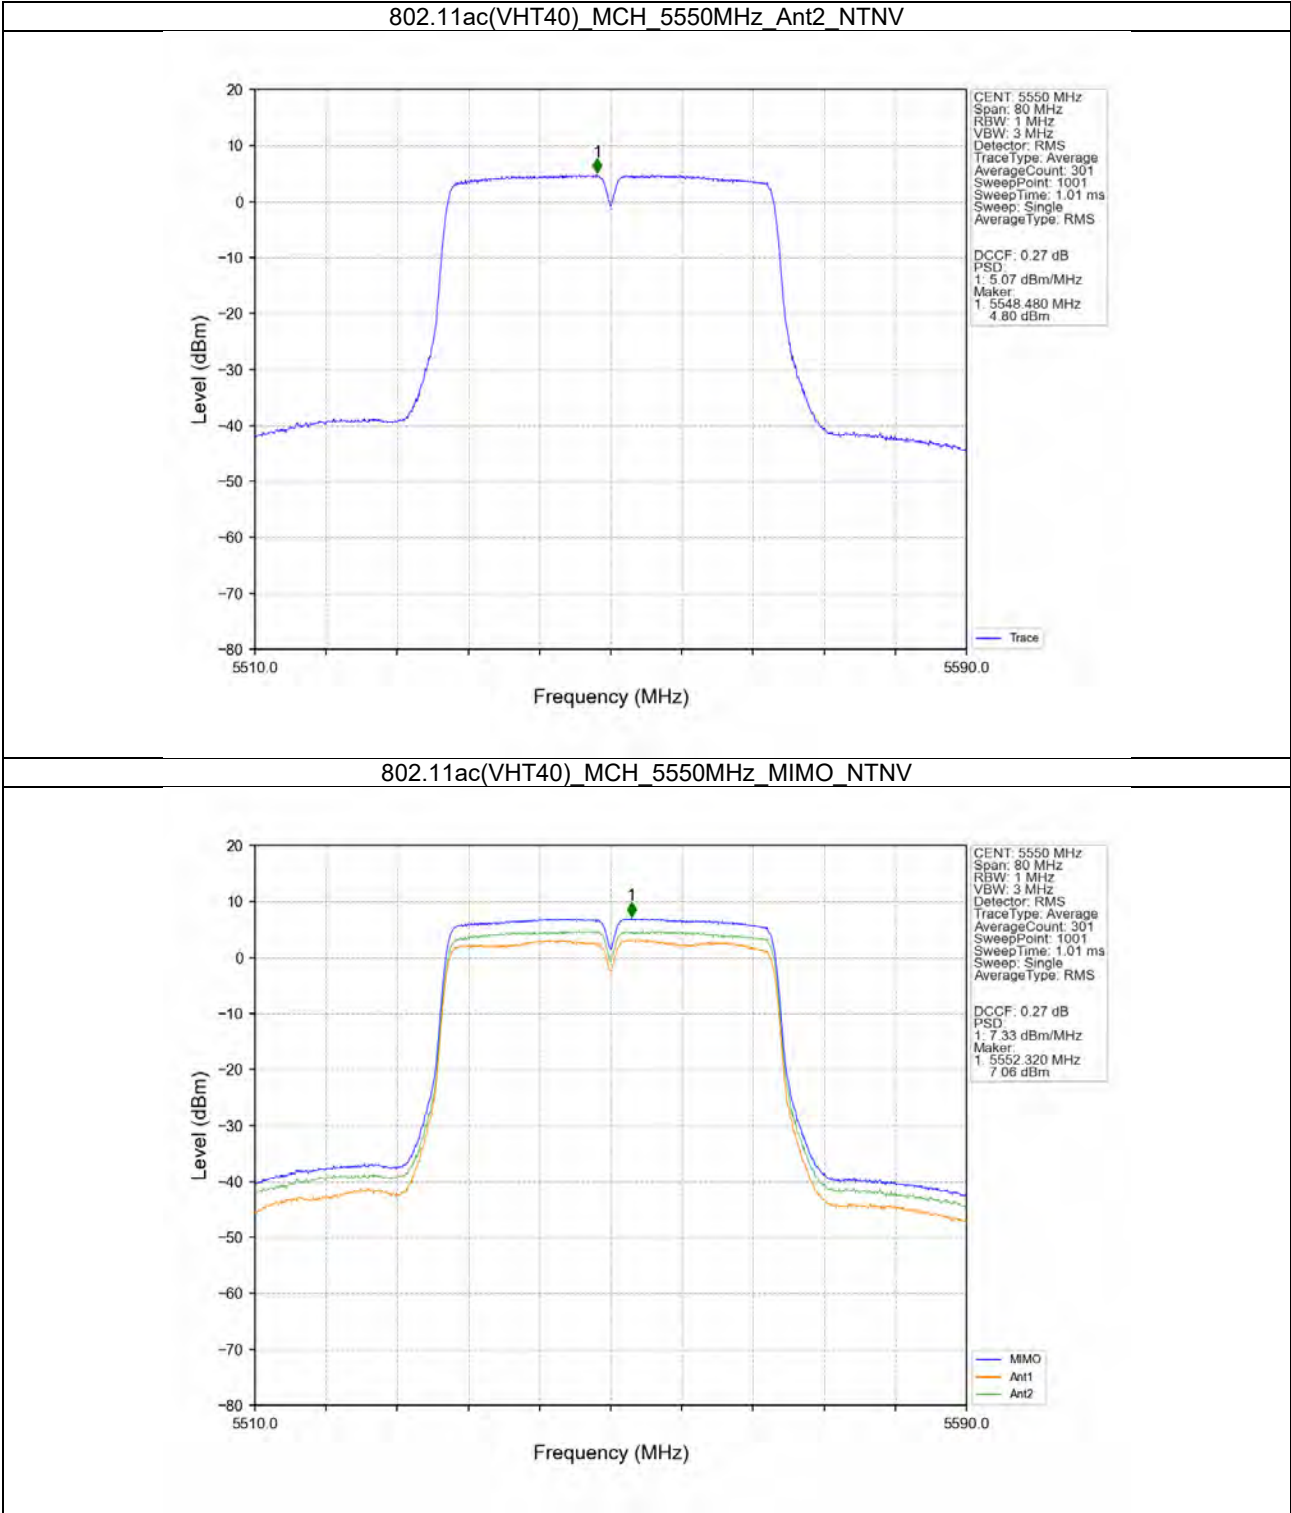




SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 387 of 1085

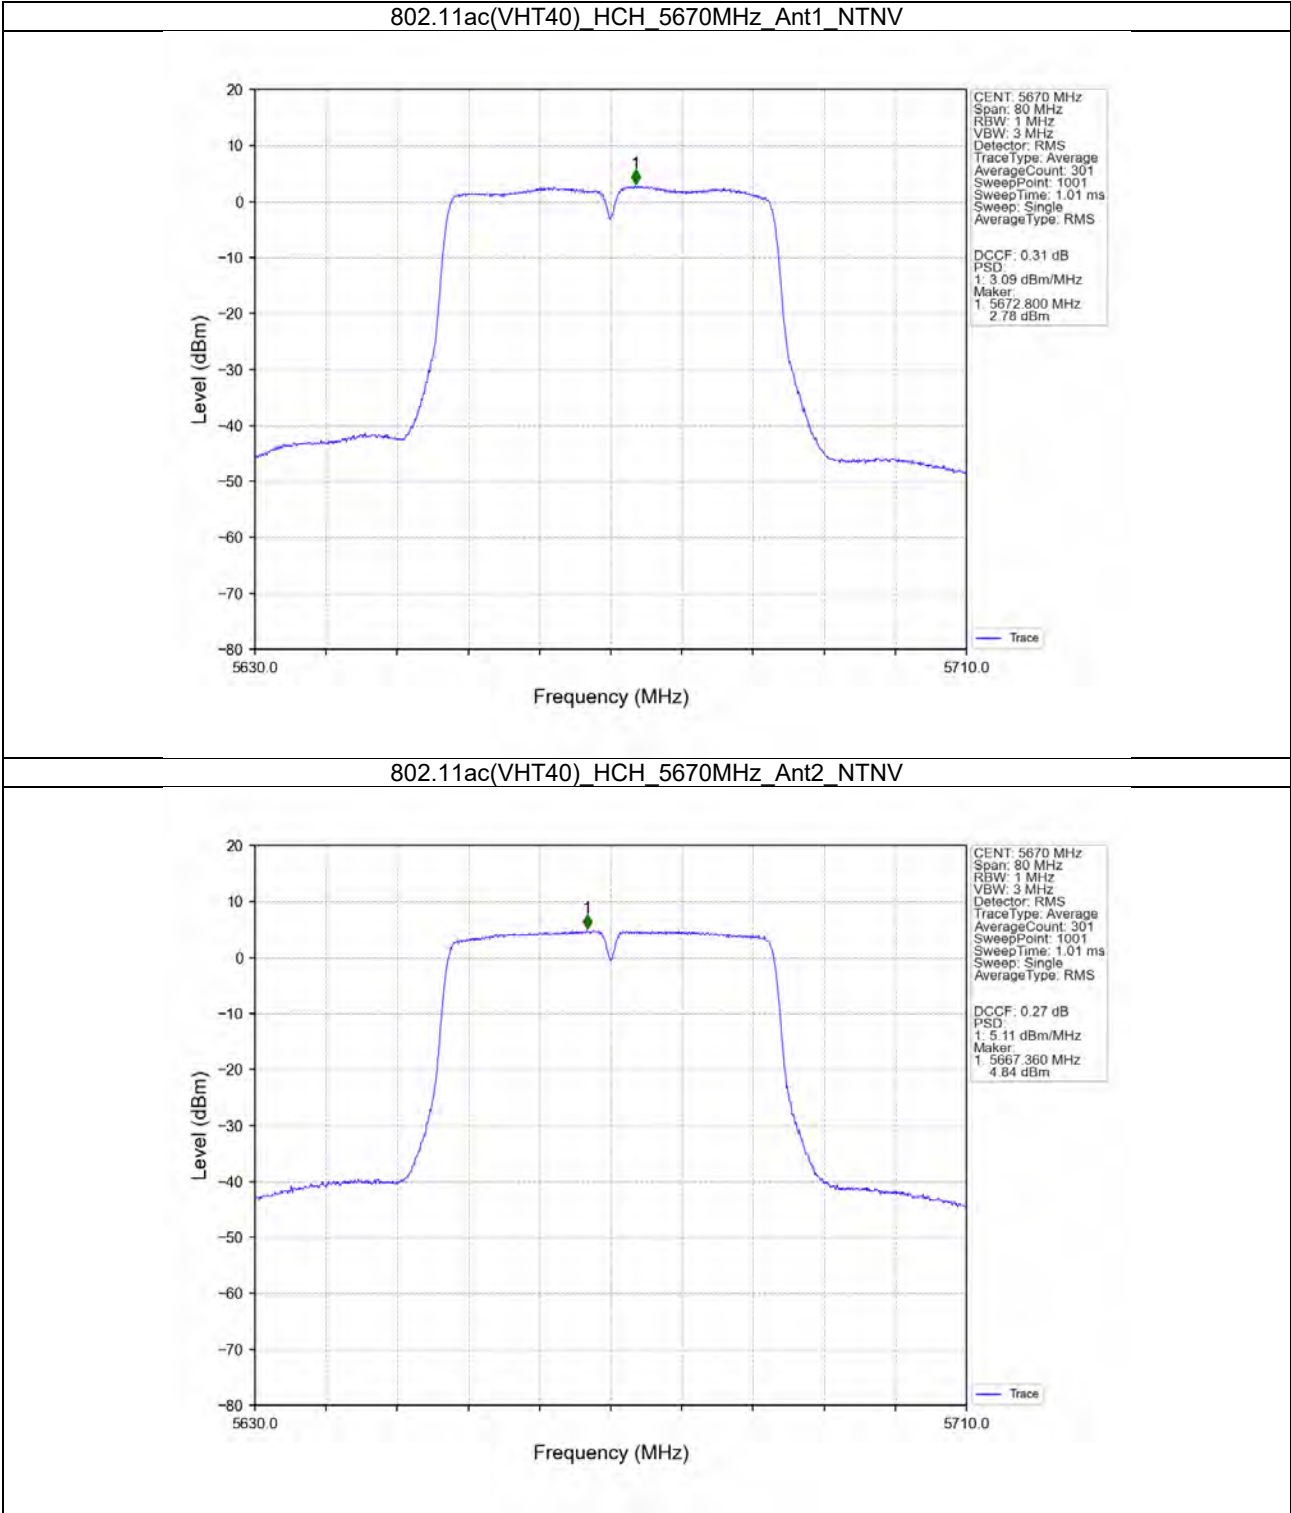

802.11ac(VHT40)_HCH_5670MHz_MIMO_NTNV

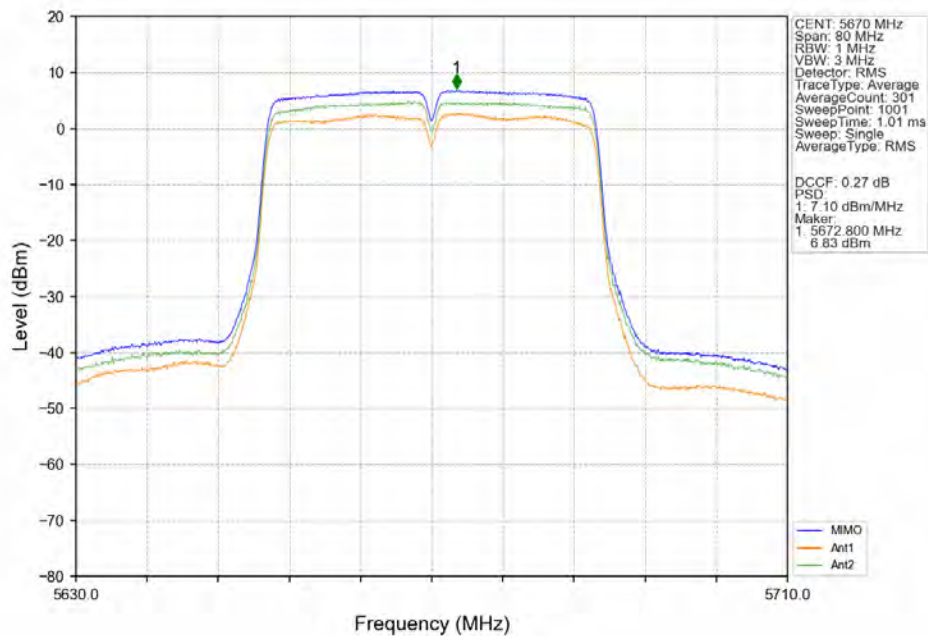


802.11ac(VHT80)_MCH_5210MHz_Ant1_NTNV

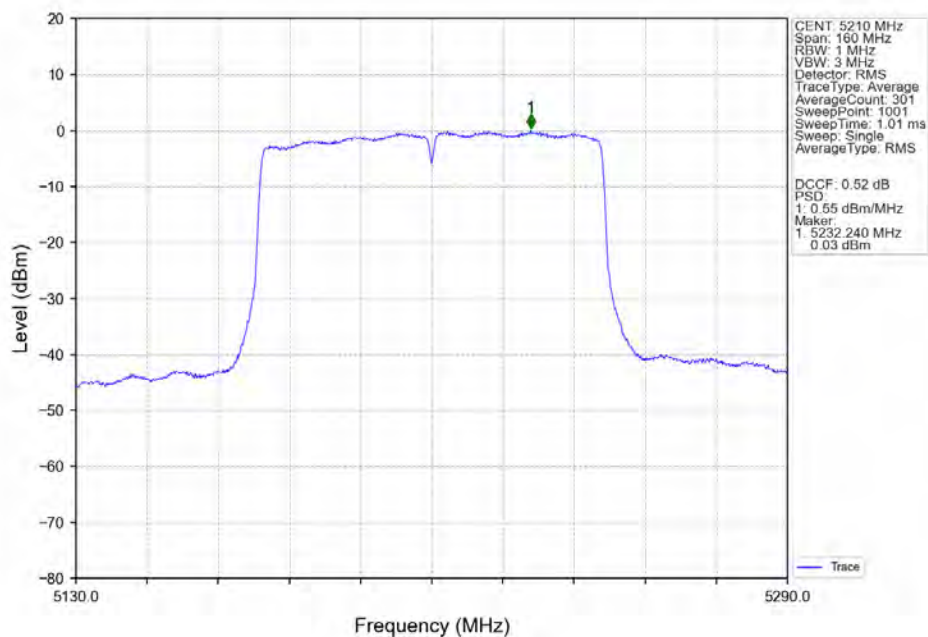



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 389 of 1085

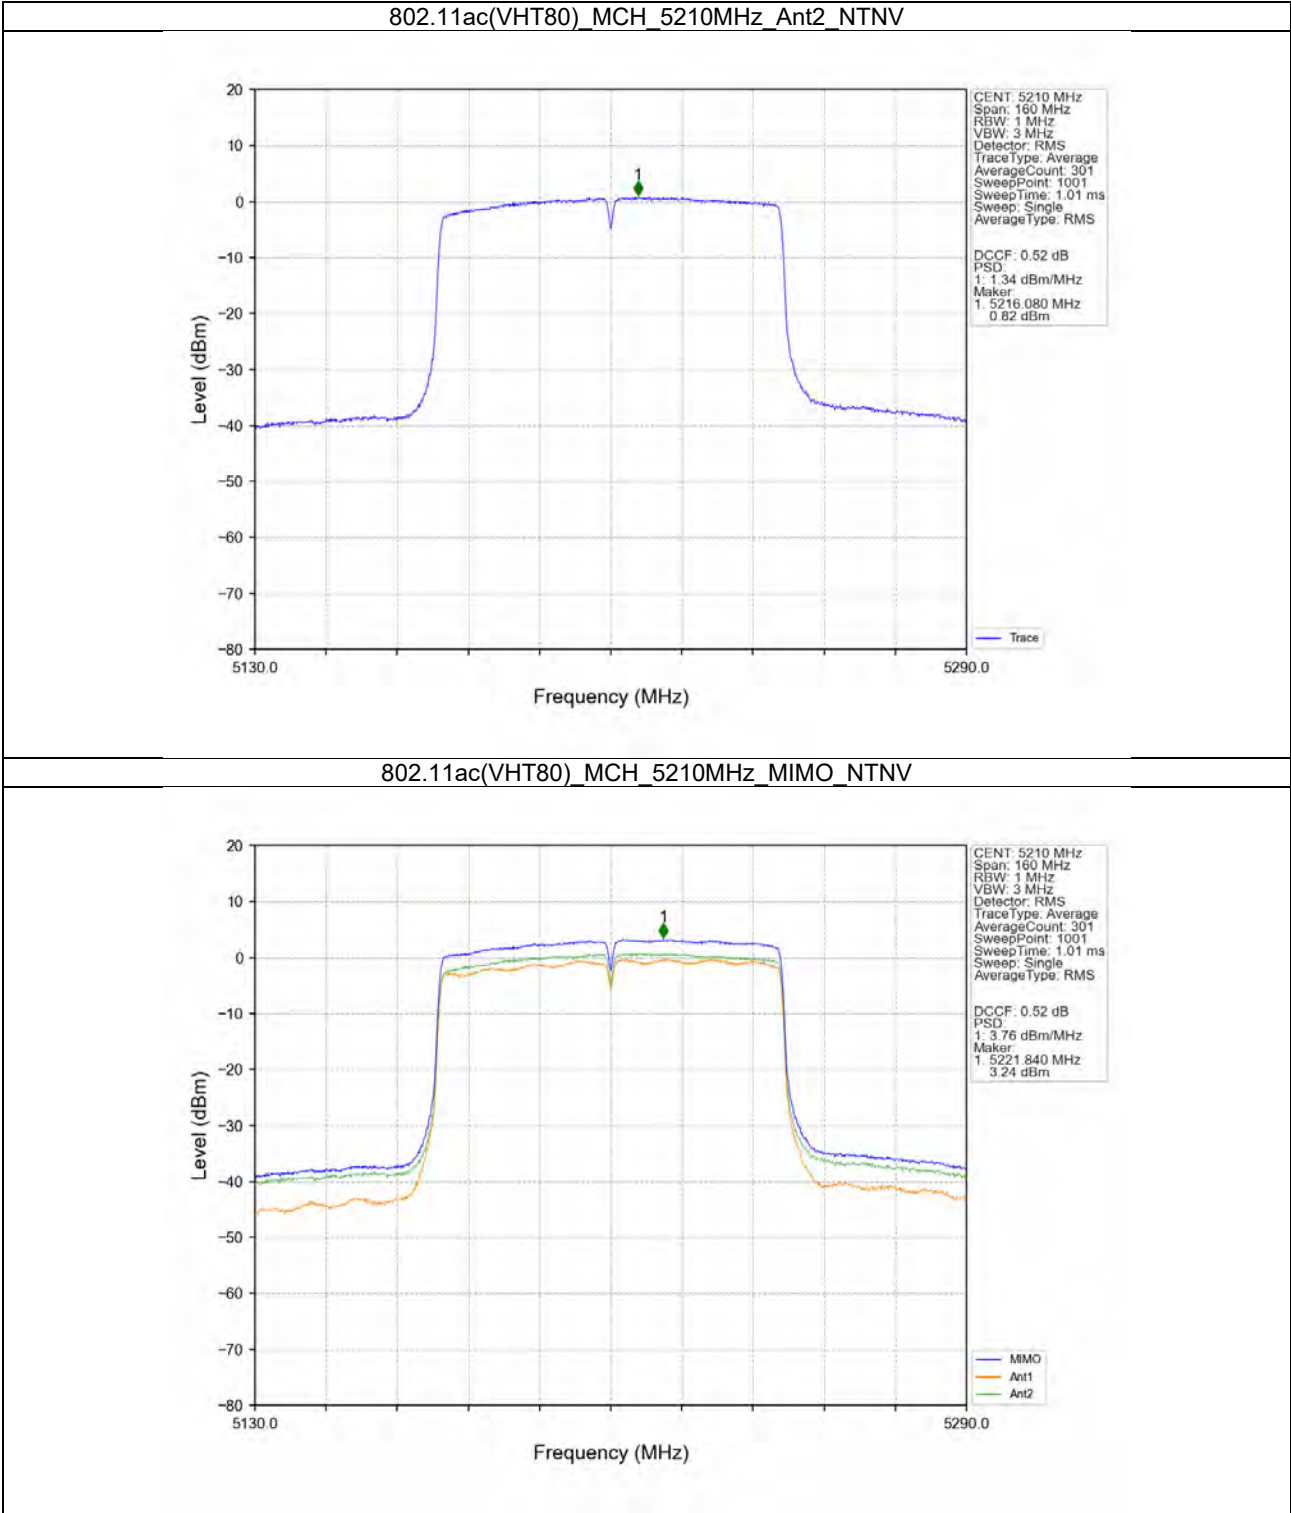



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 390 of 1085

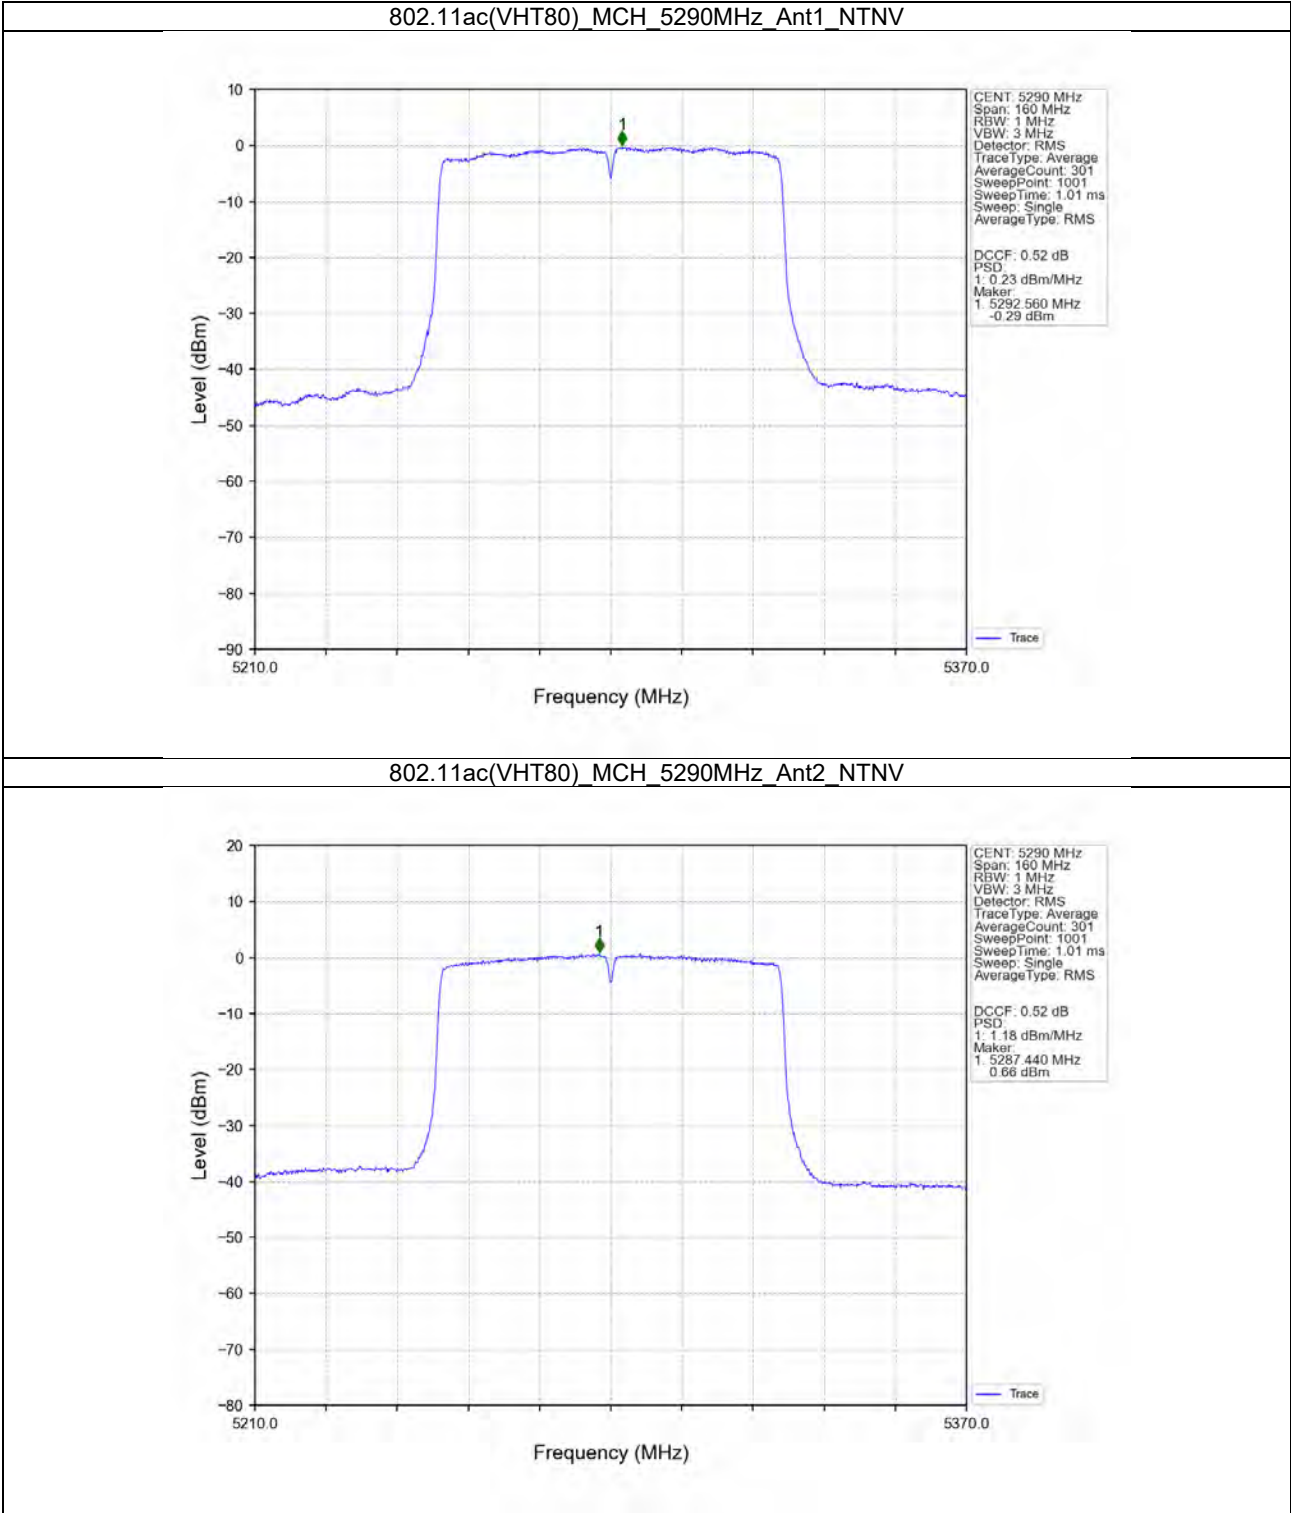



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 391 of 1085

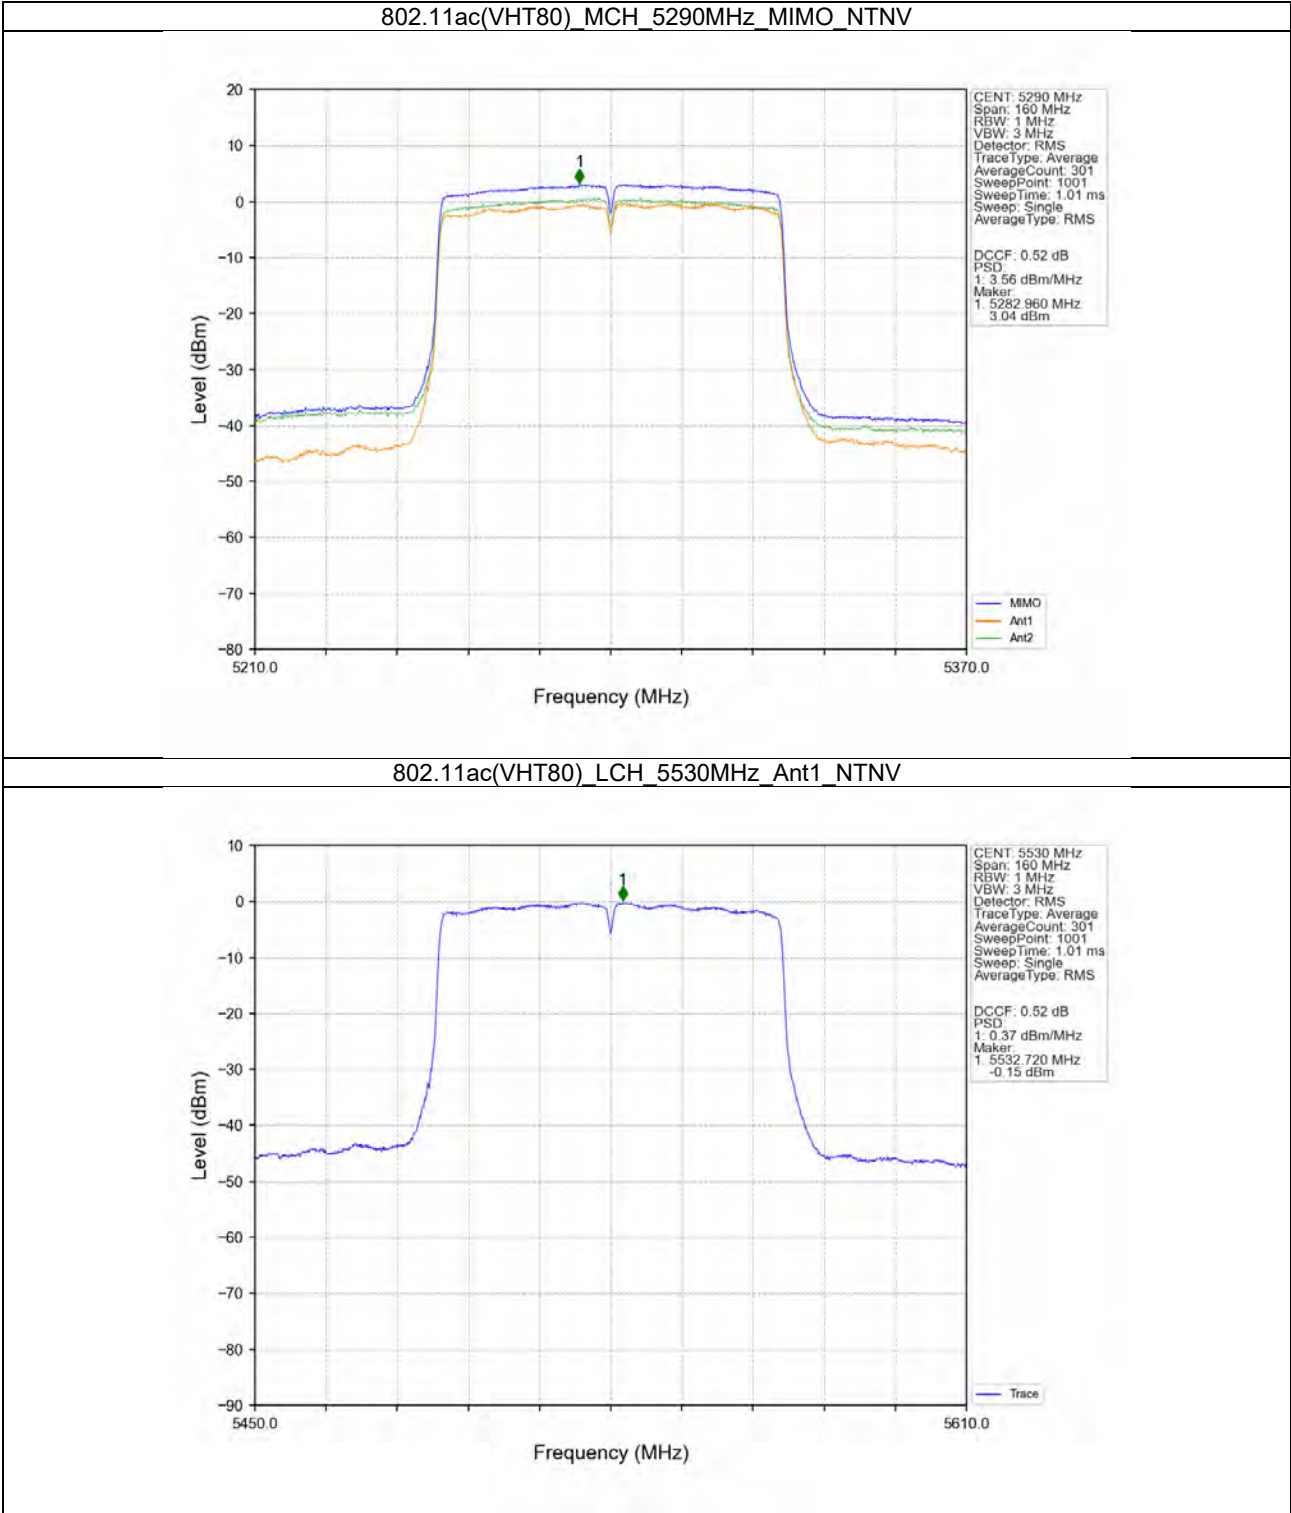



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 392 of 1085

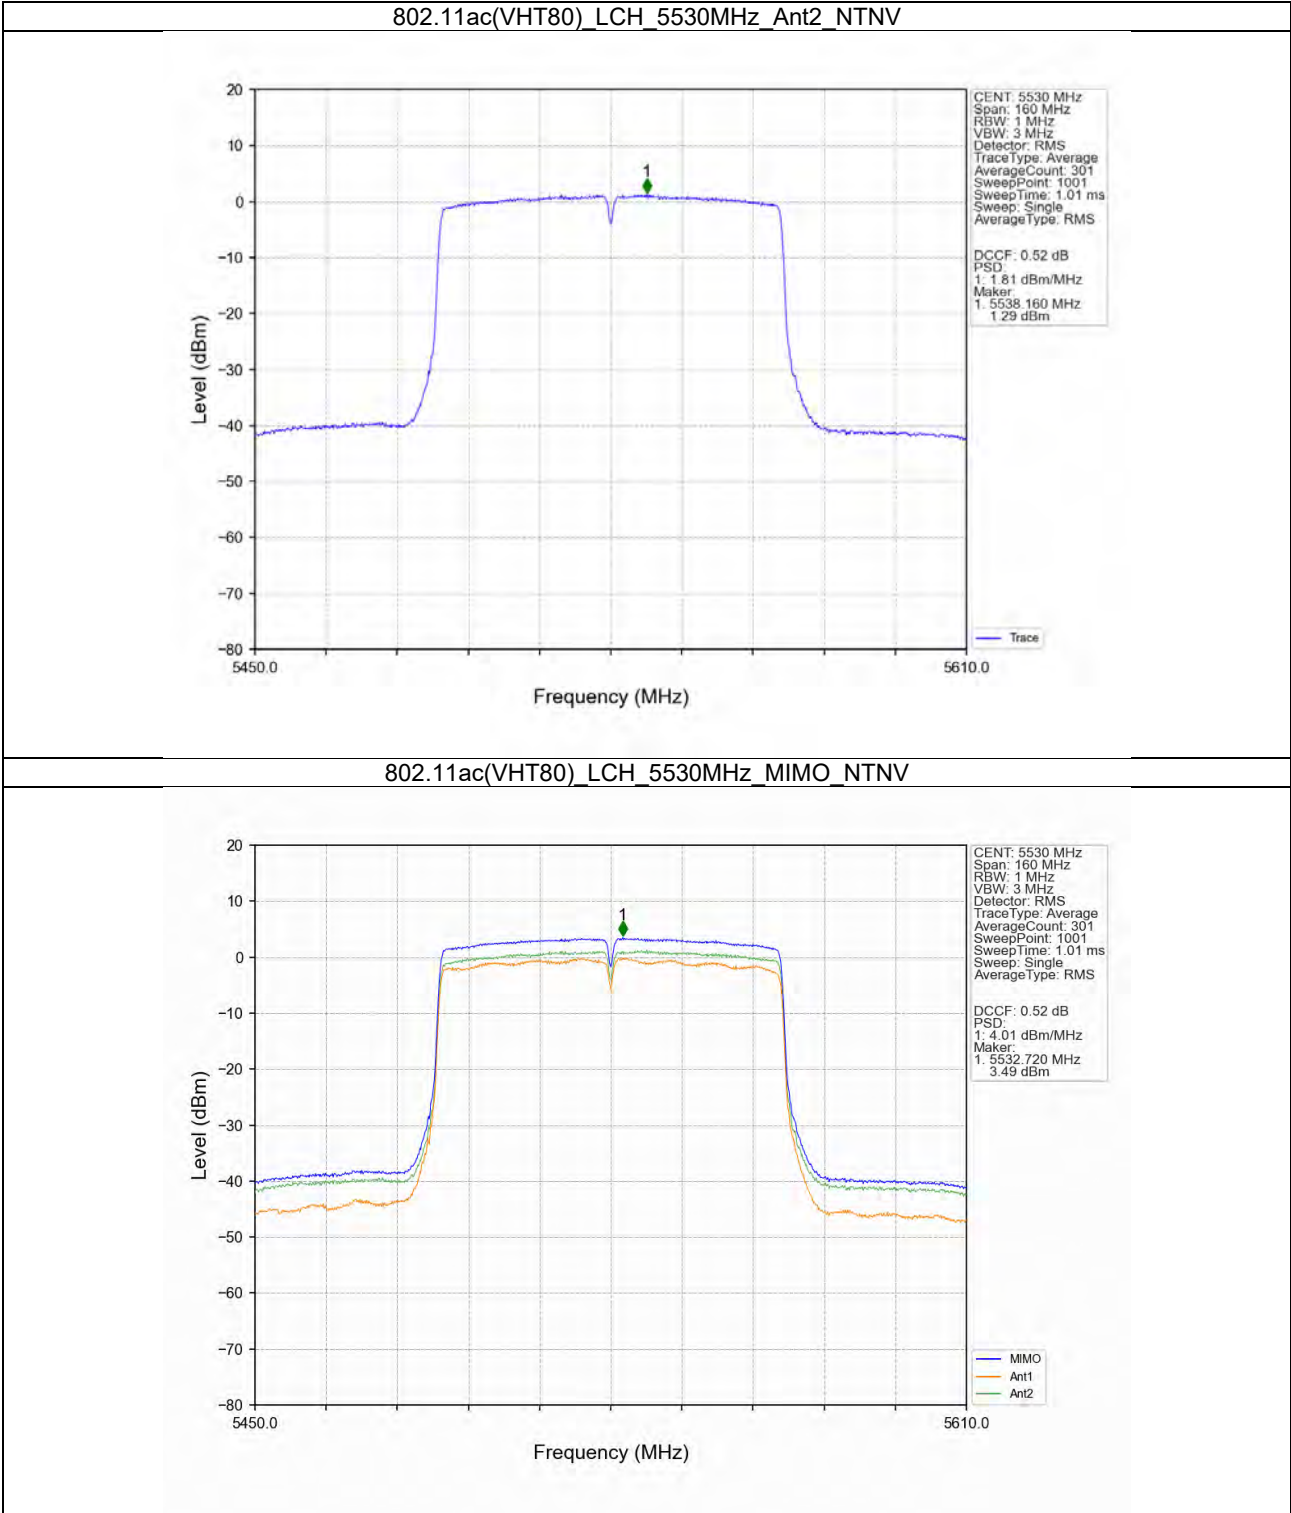



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 393 of 1085

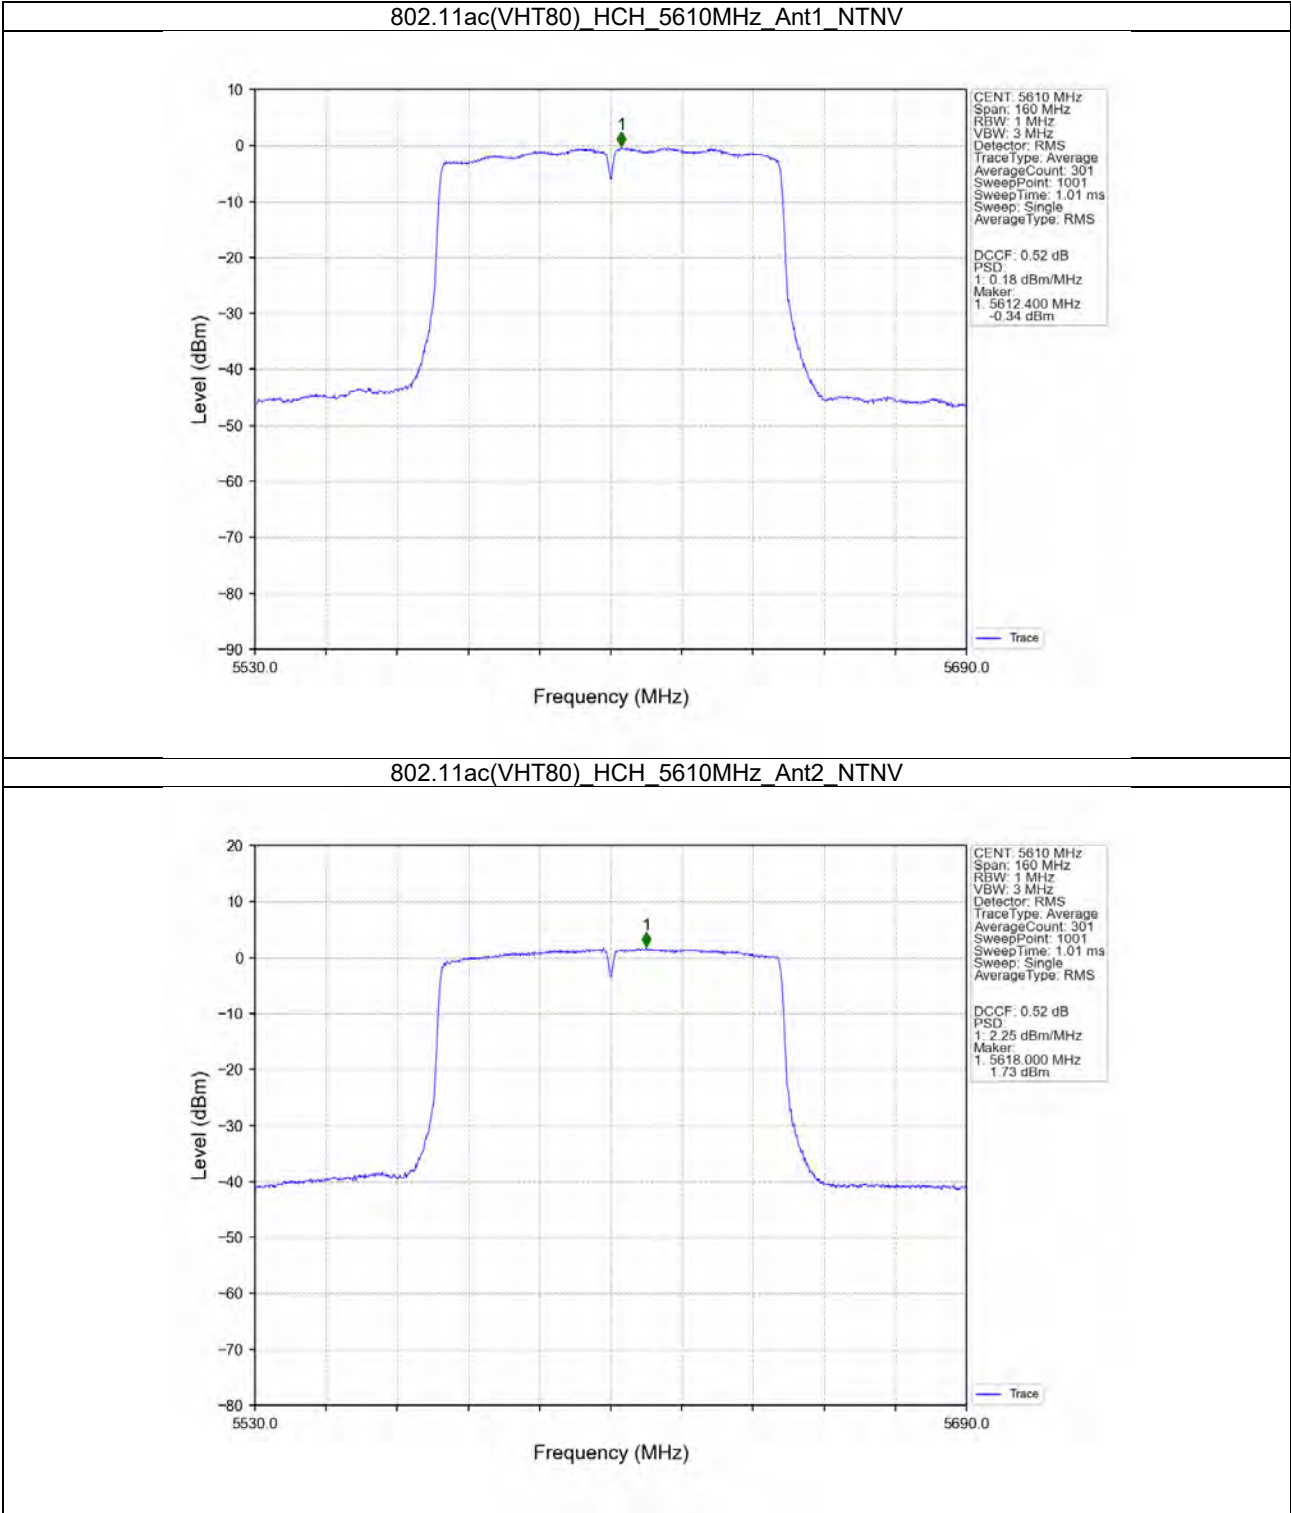



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 394 of 1085

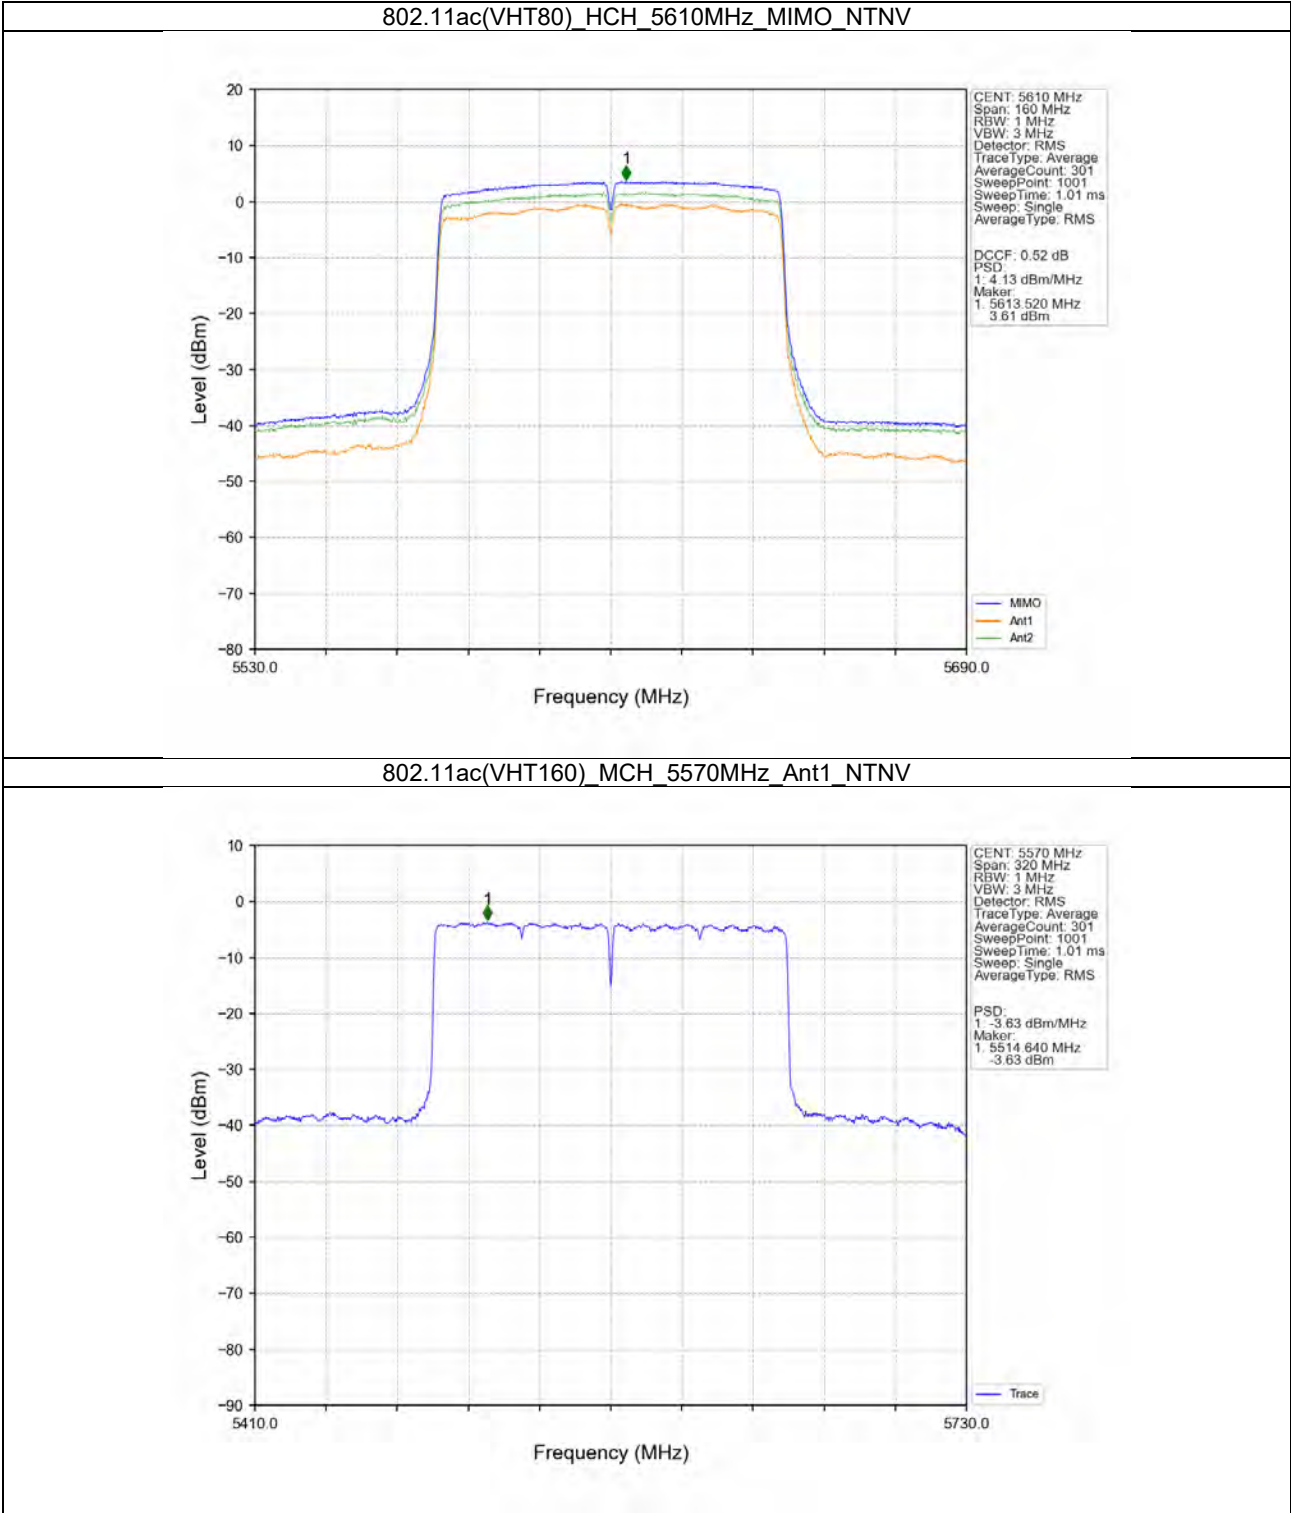



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 395 of 1085

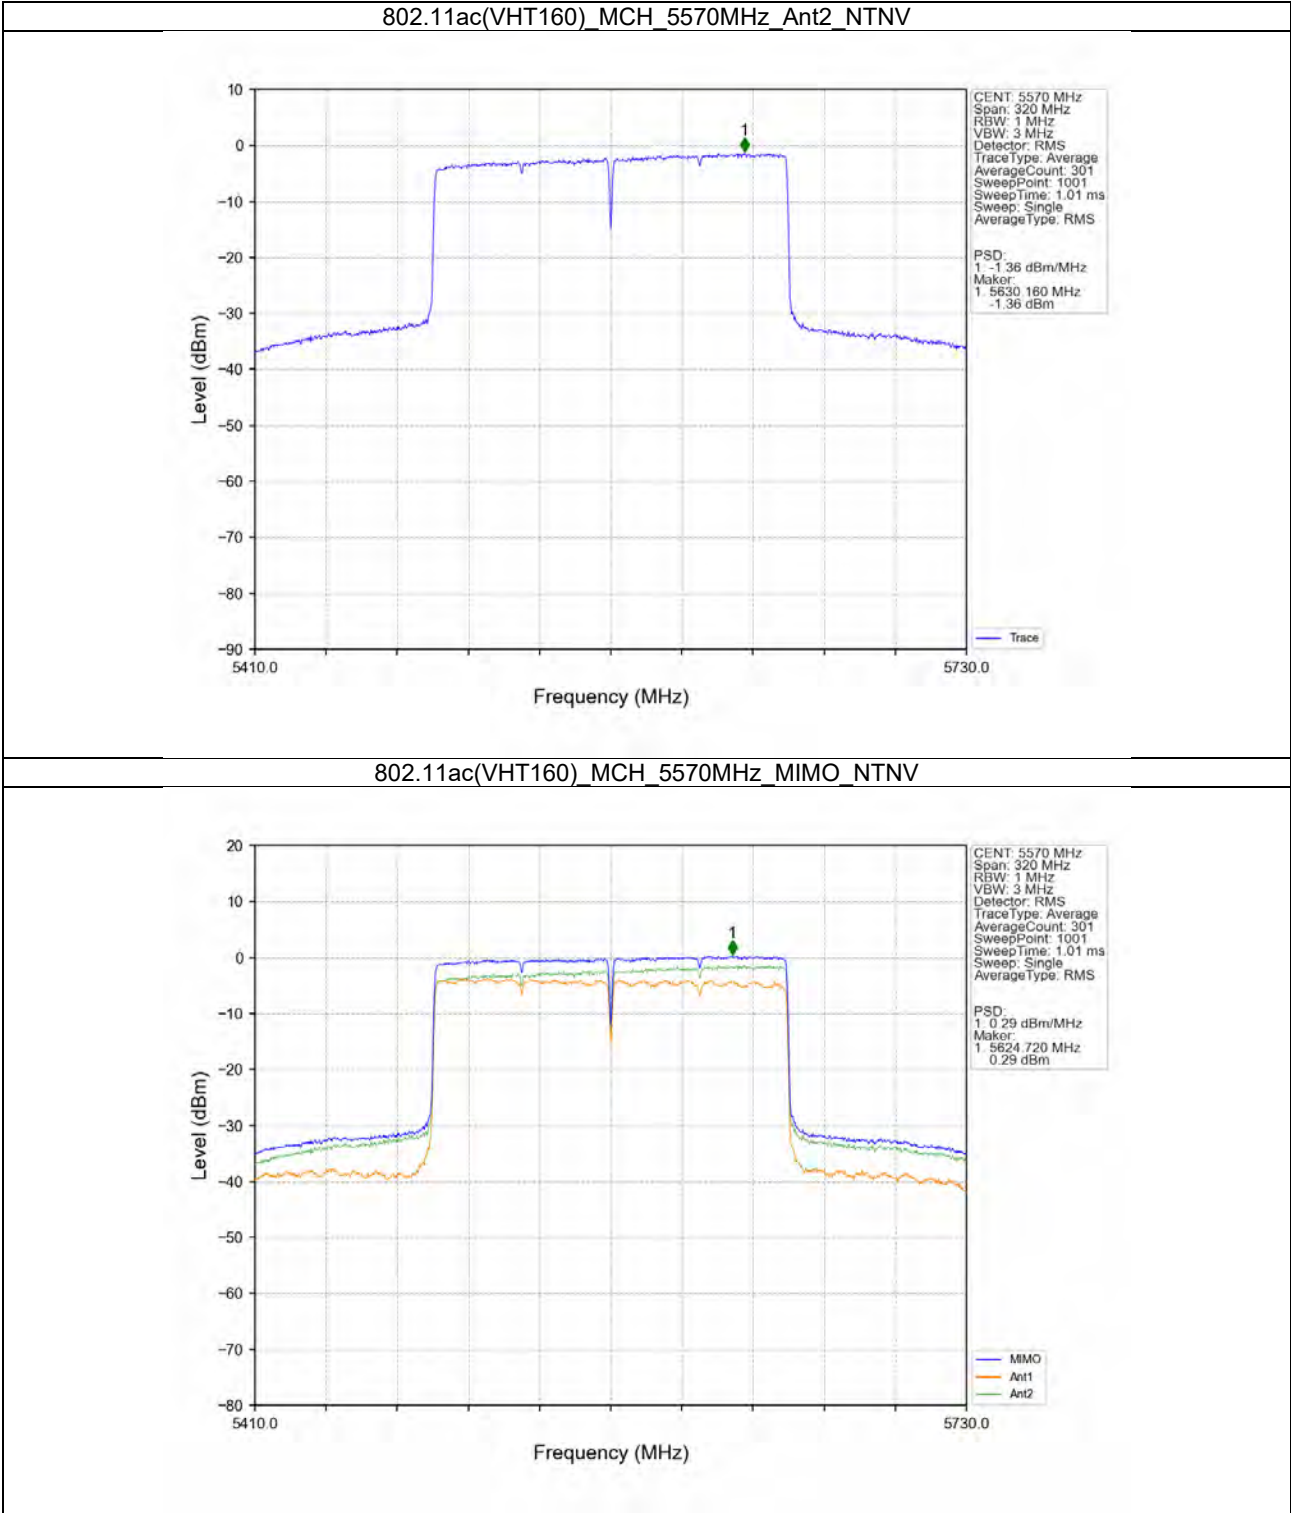




SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 396 of 1085

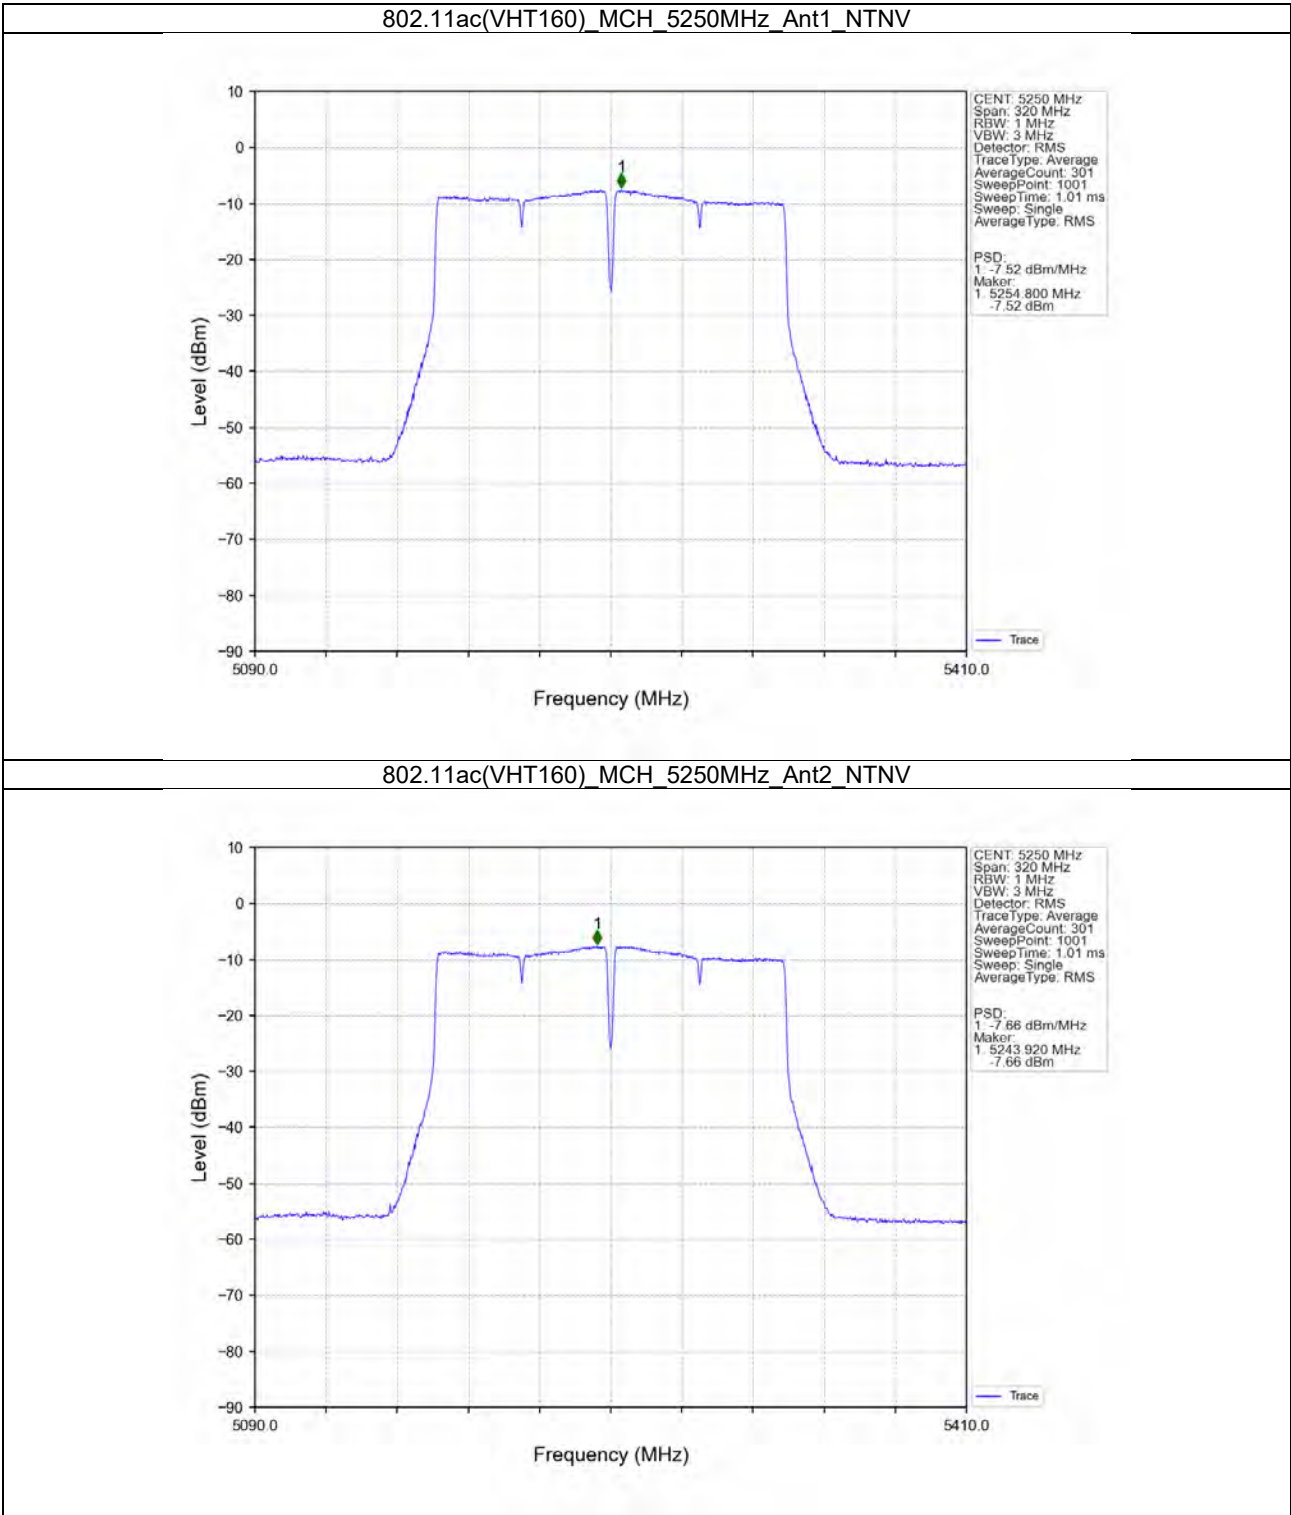

802.11ac(VHT160)_MCH_5250MHz_MIMO_NTNV

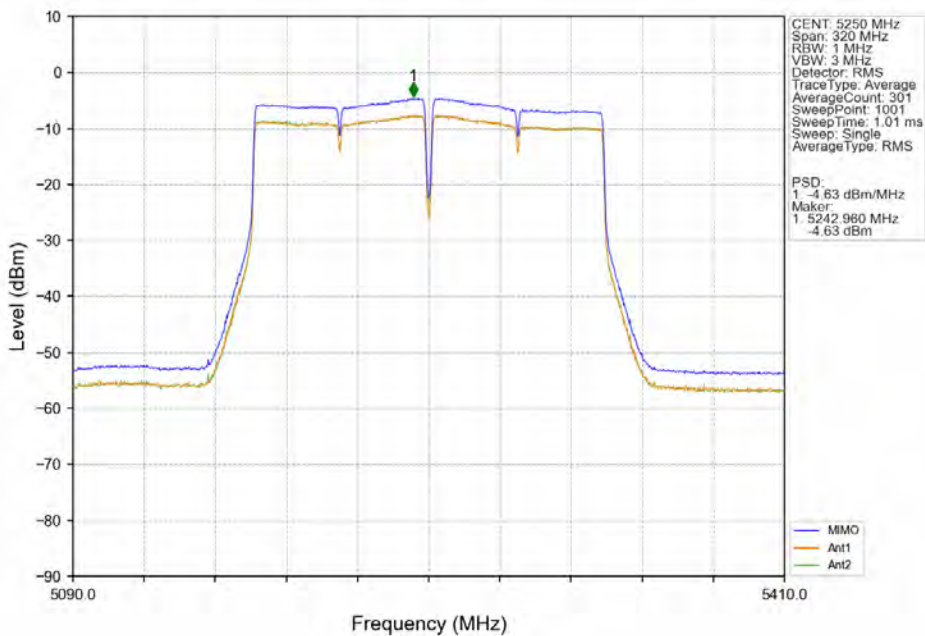


802.11ax(HEW20)_LCH_5180MHz_SU_/_Ant1_NTNV

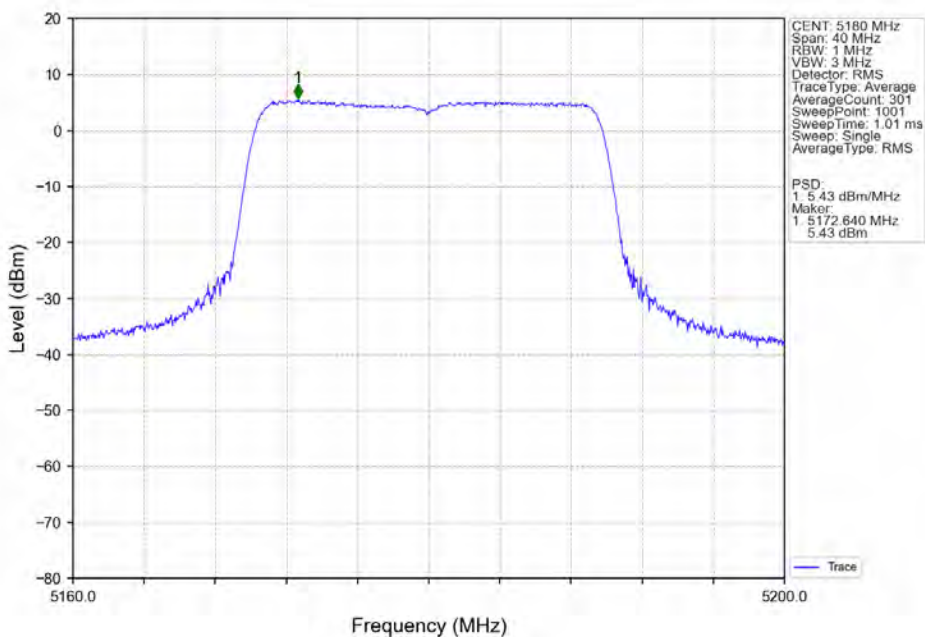



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 398 of 1085

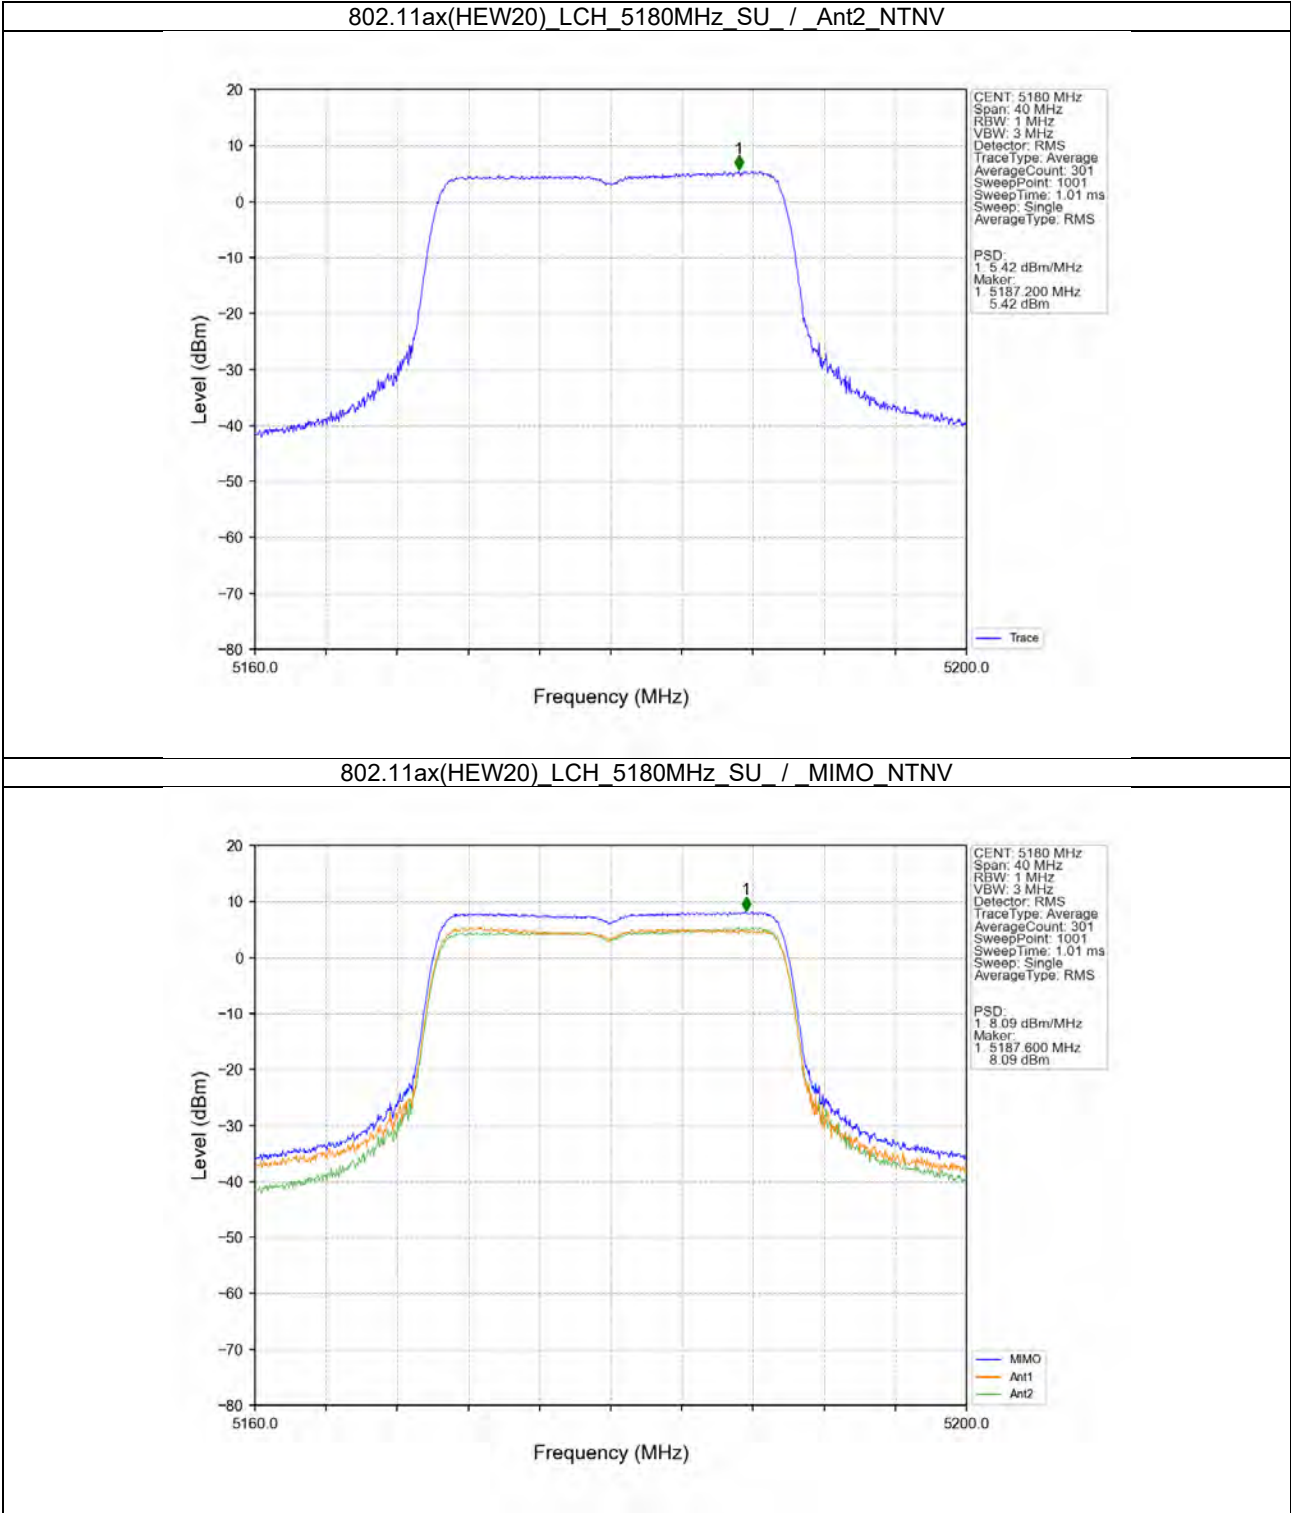



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 399 of 1085

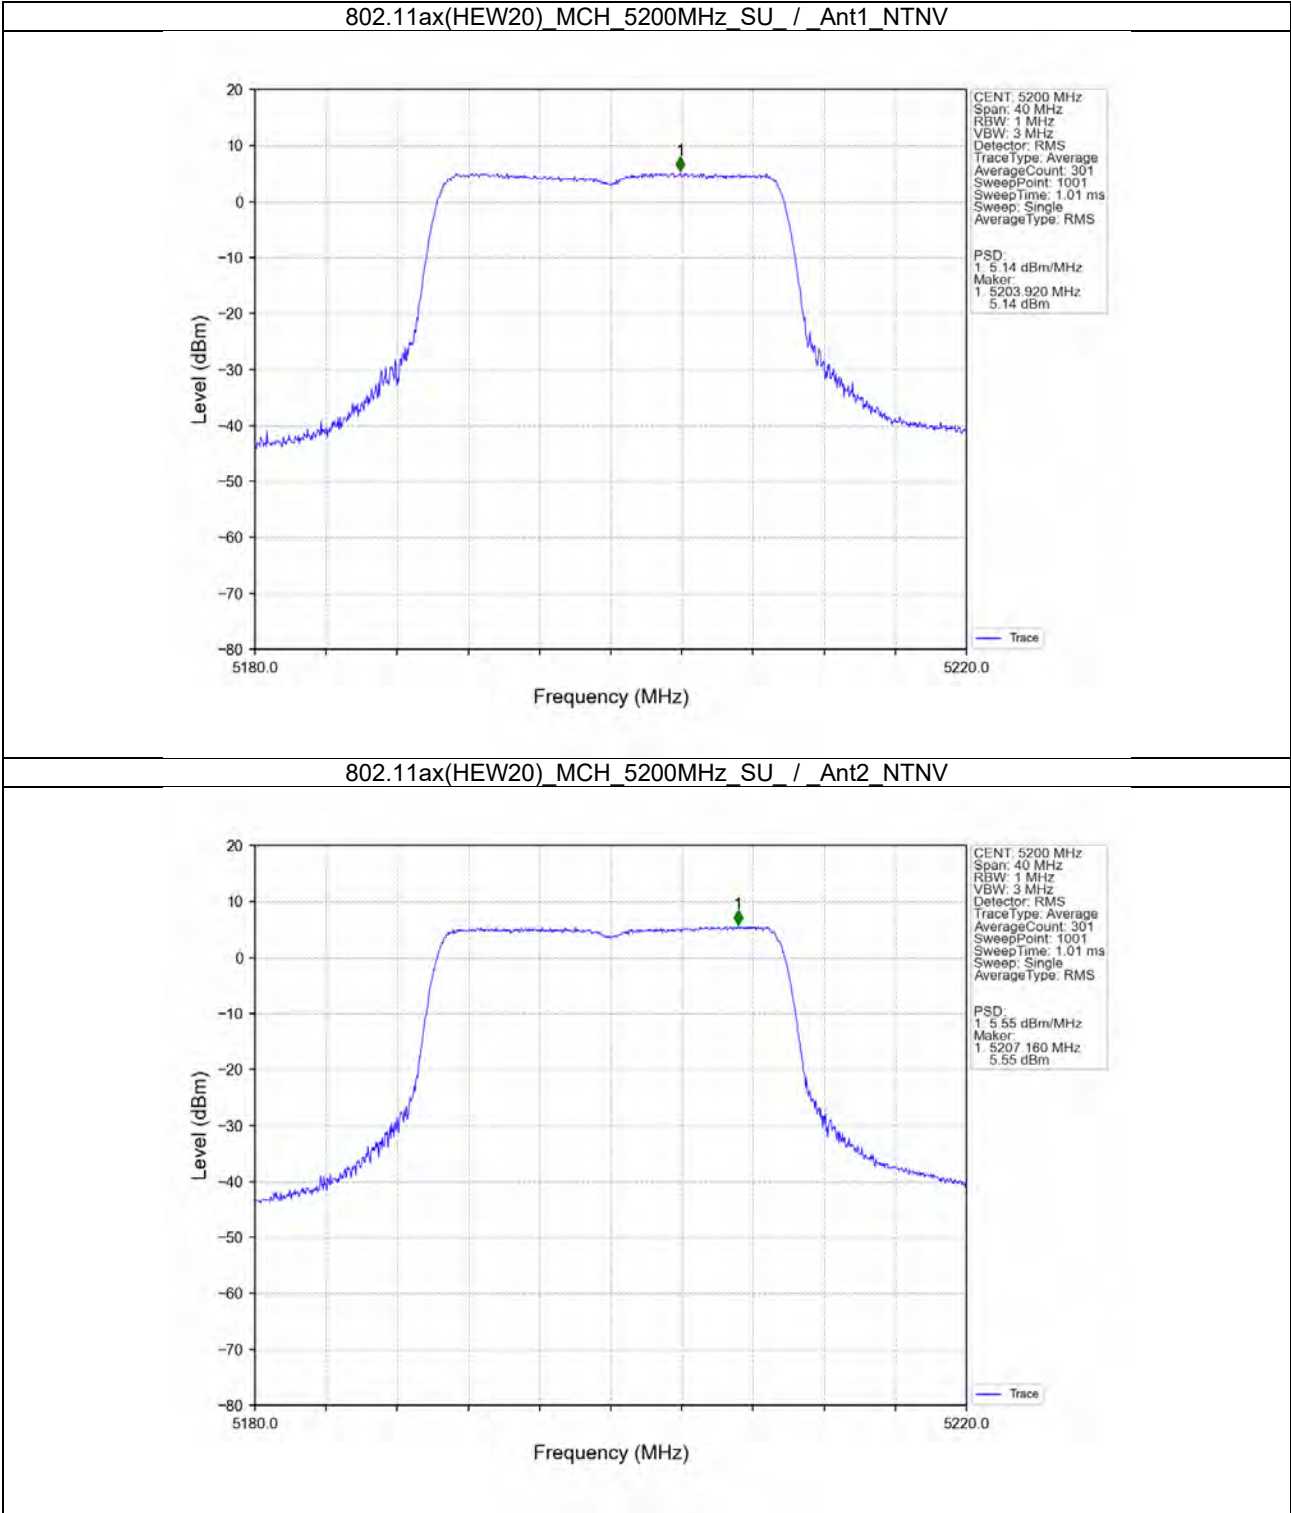



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 400 of 1085

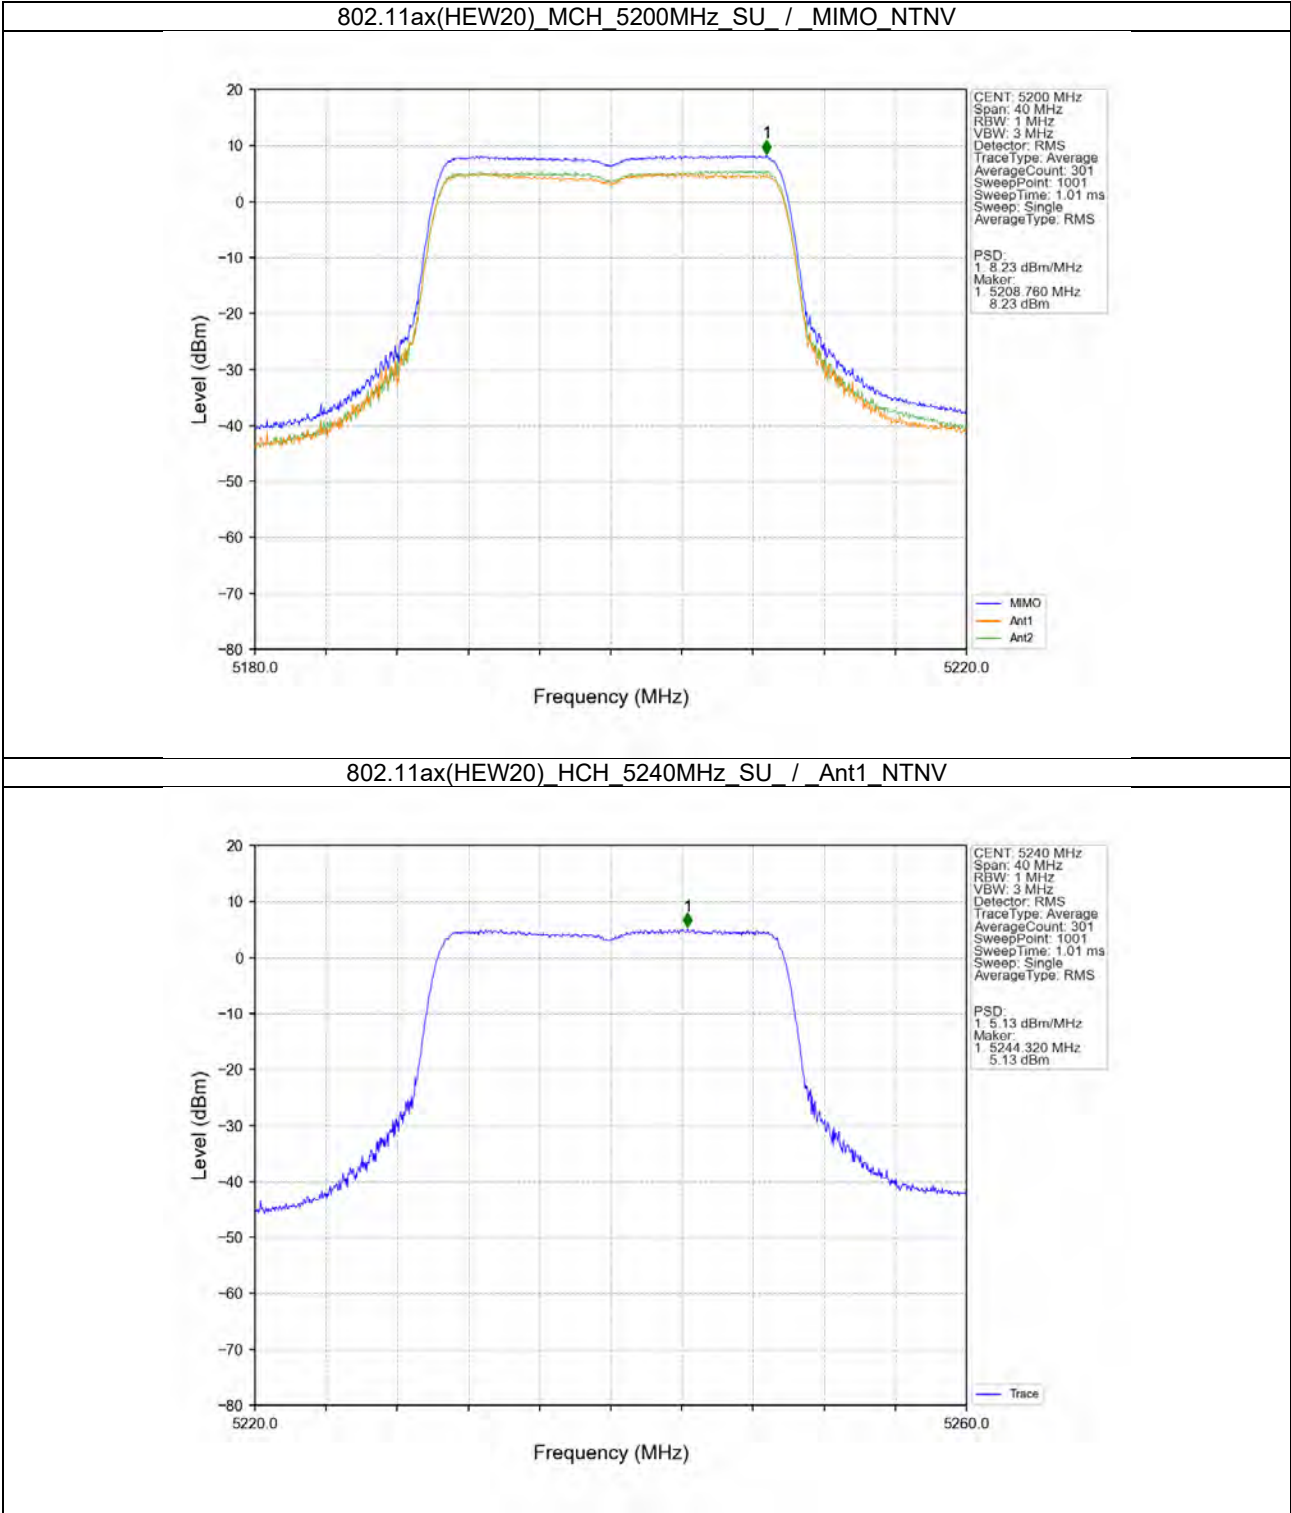



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 401 of 1085

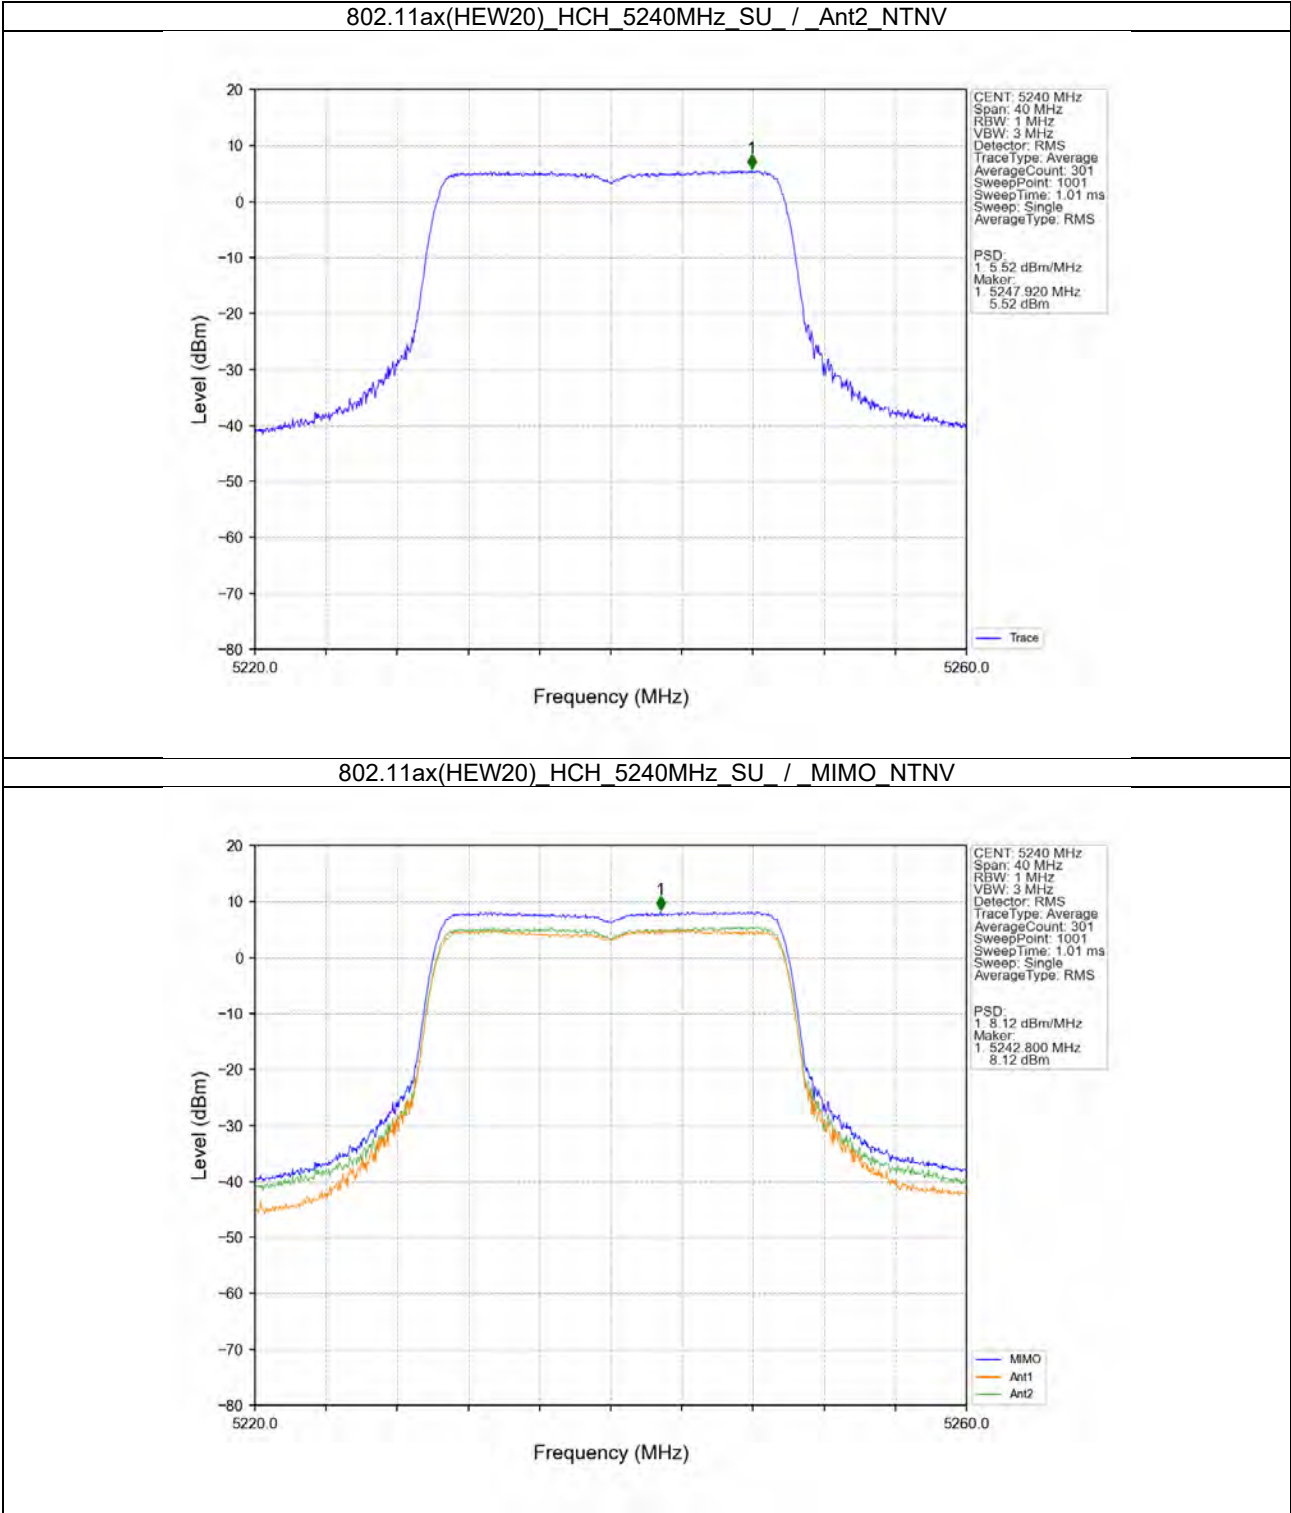



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 402 of 1085

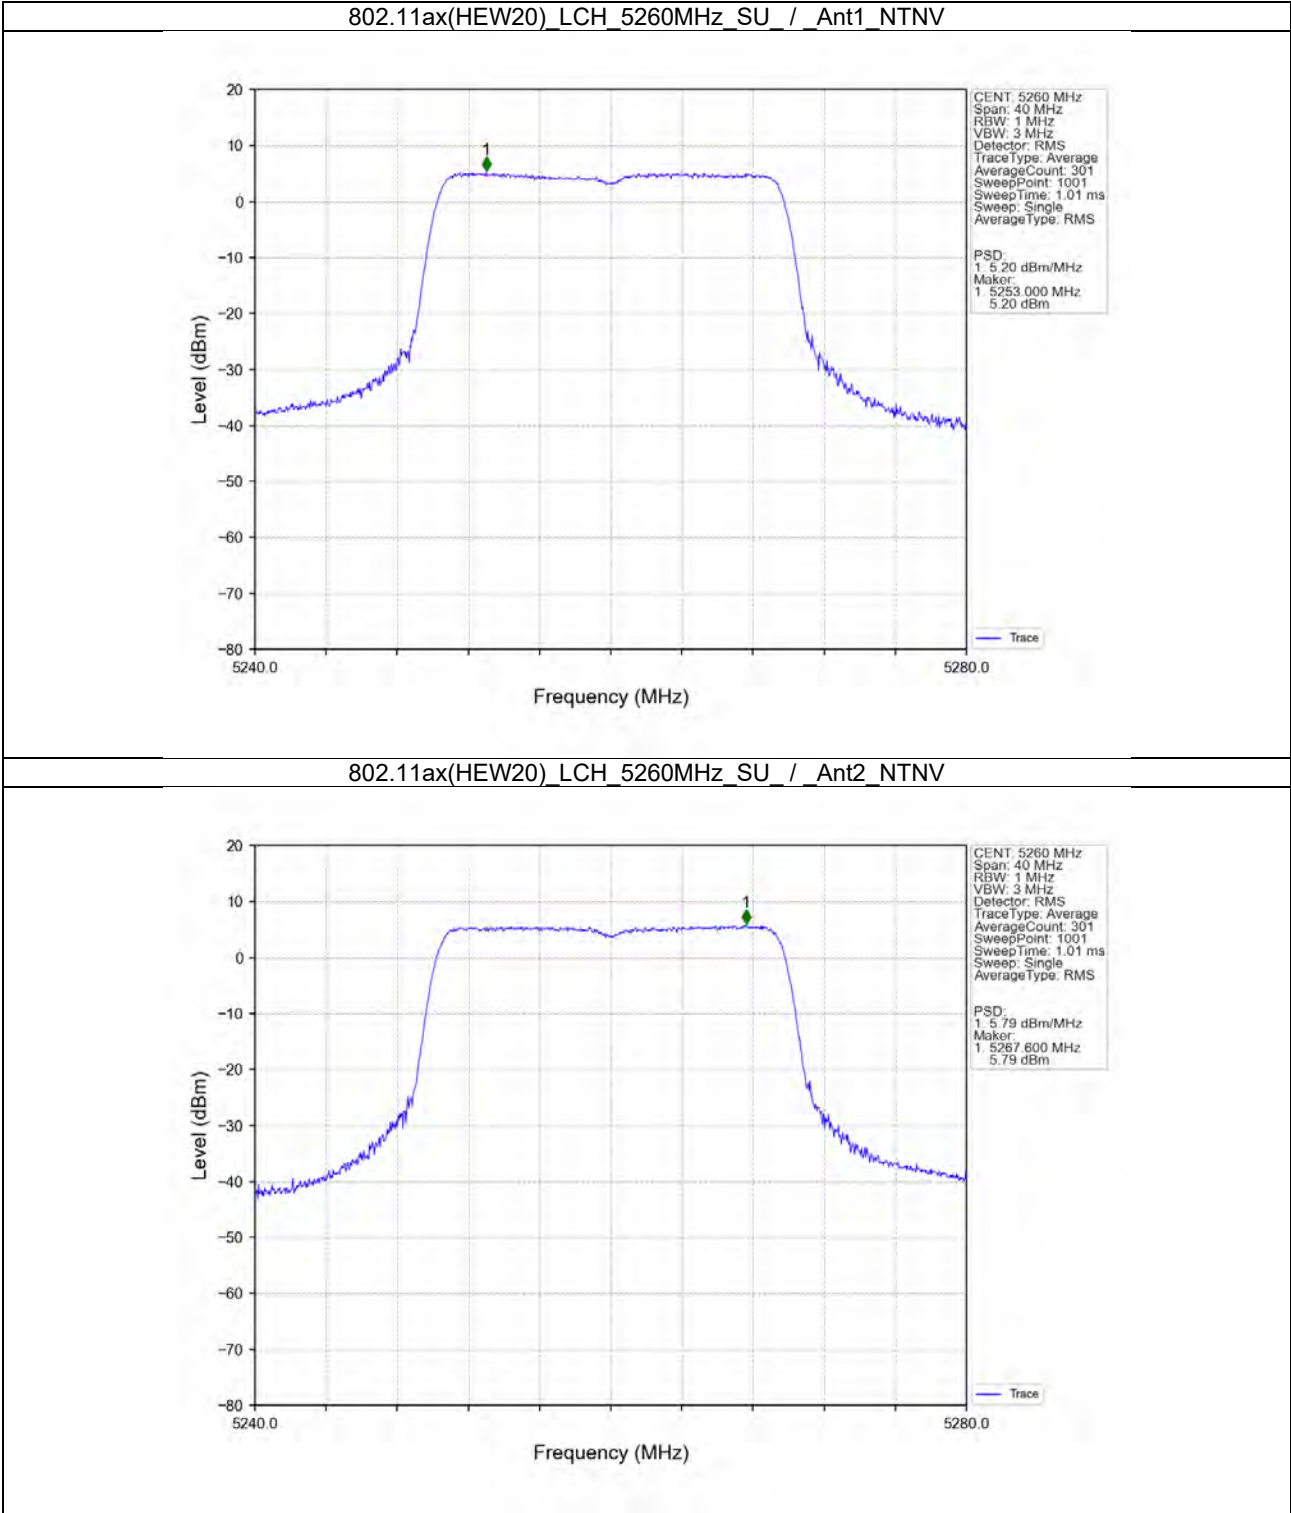



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 403 of 1085

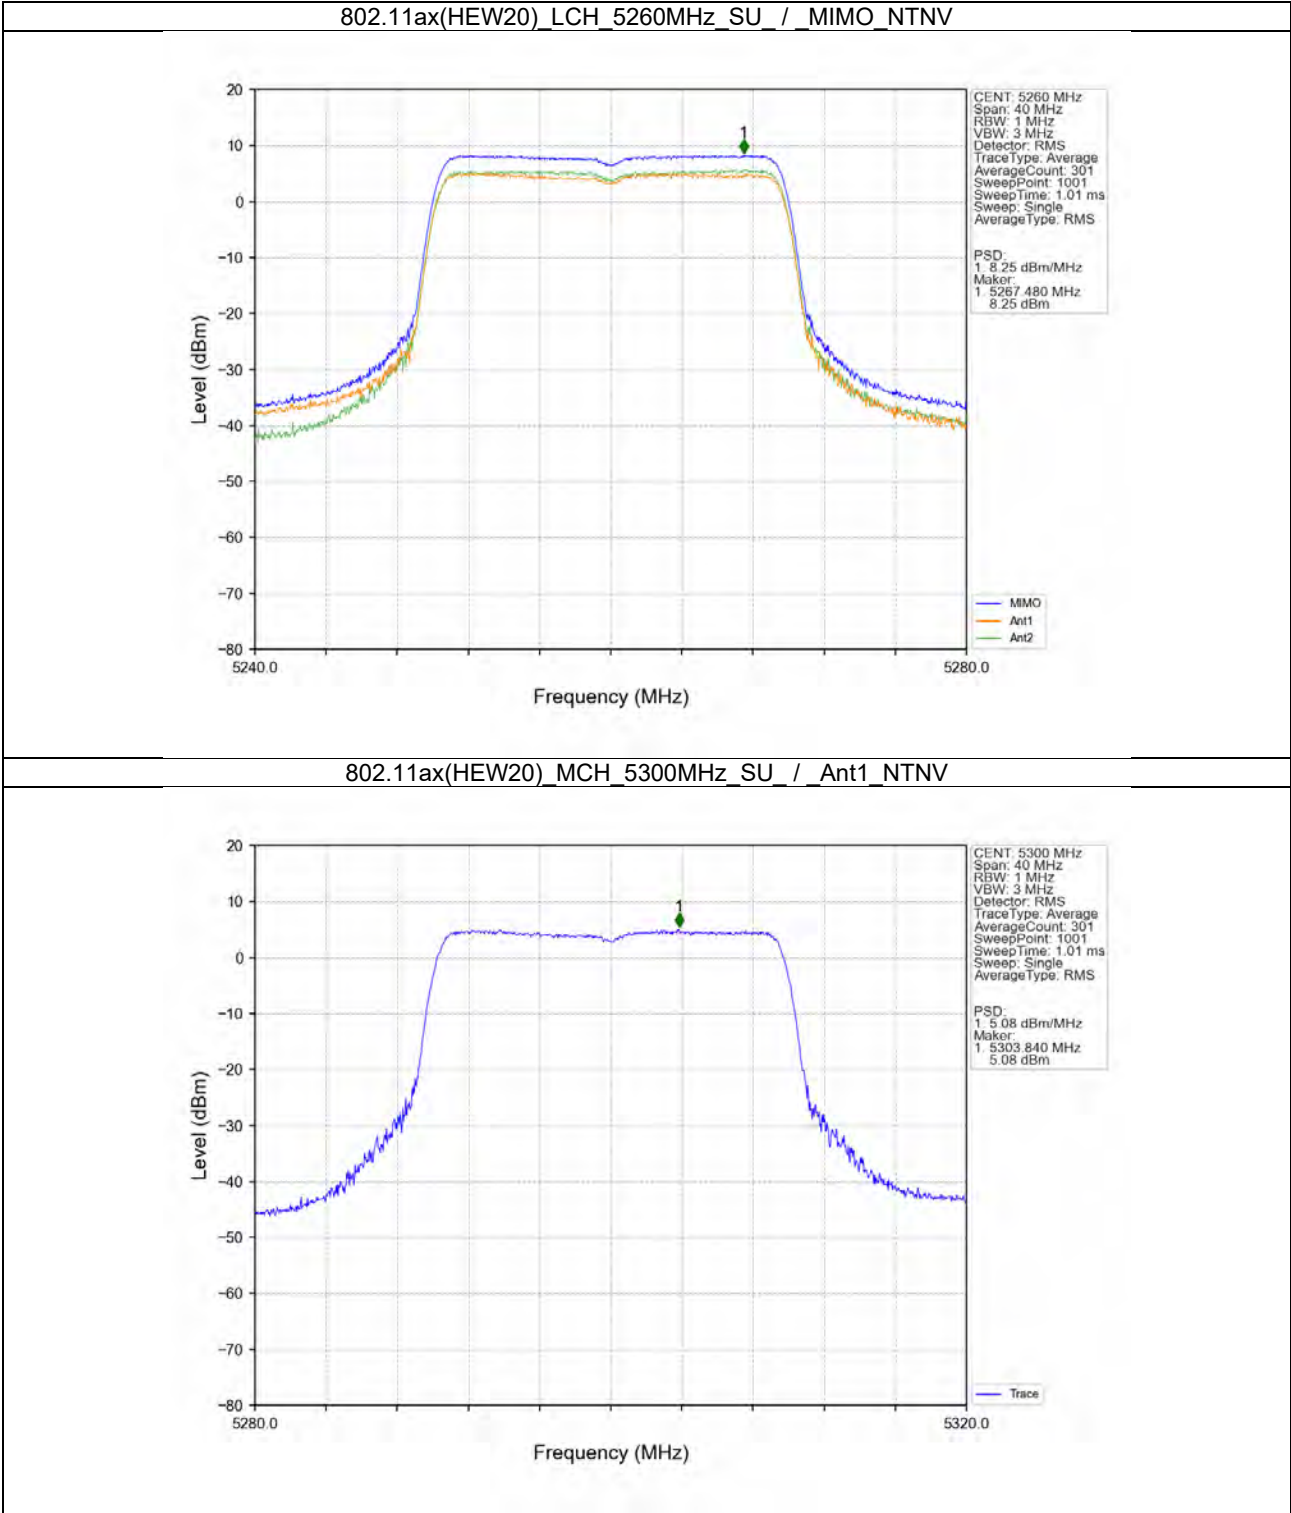



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 404 of 1085

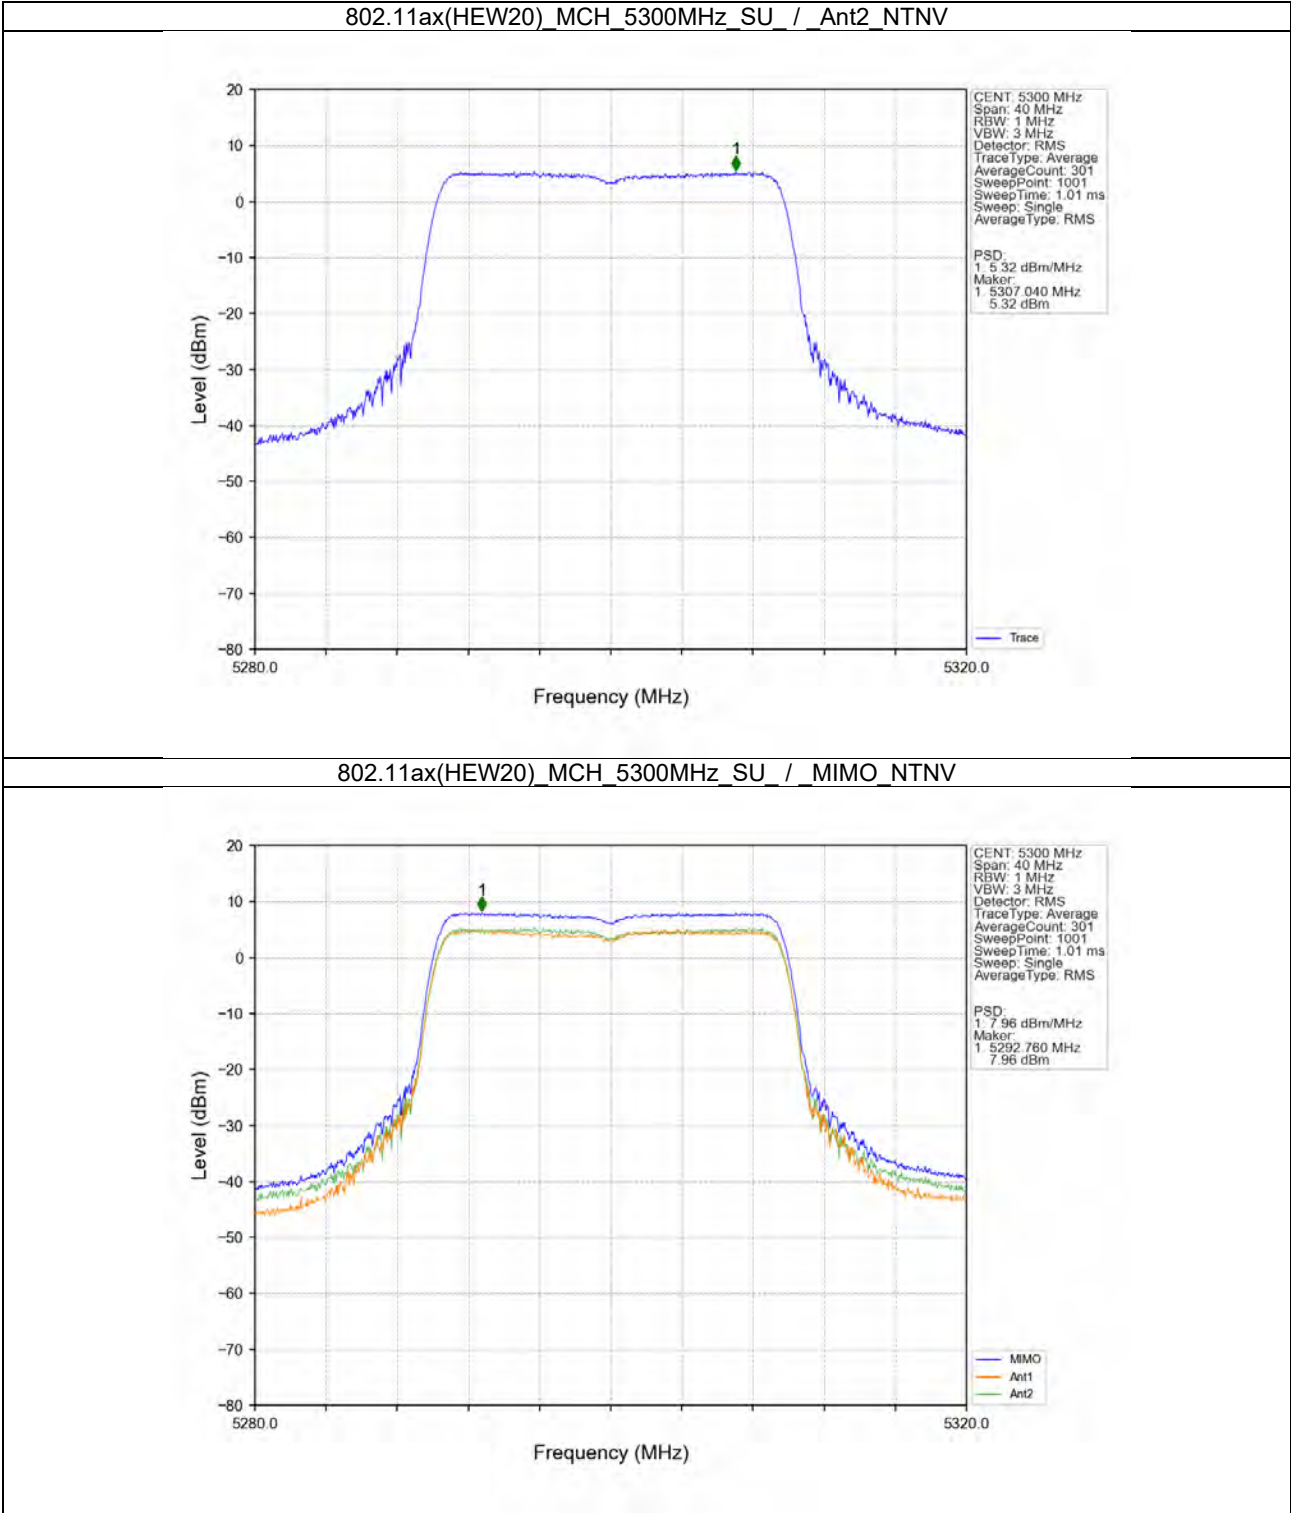



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 405 of 1085

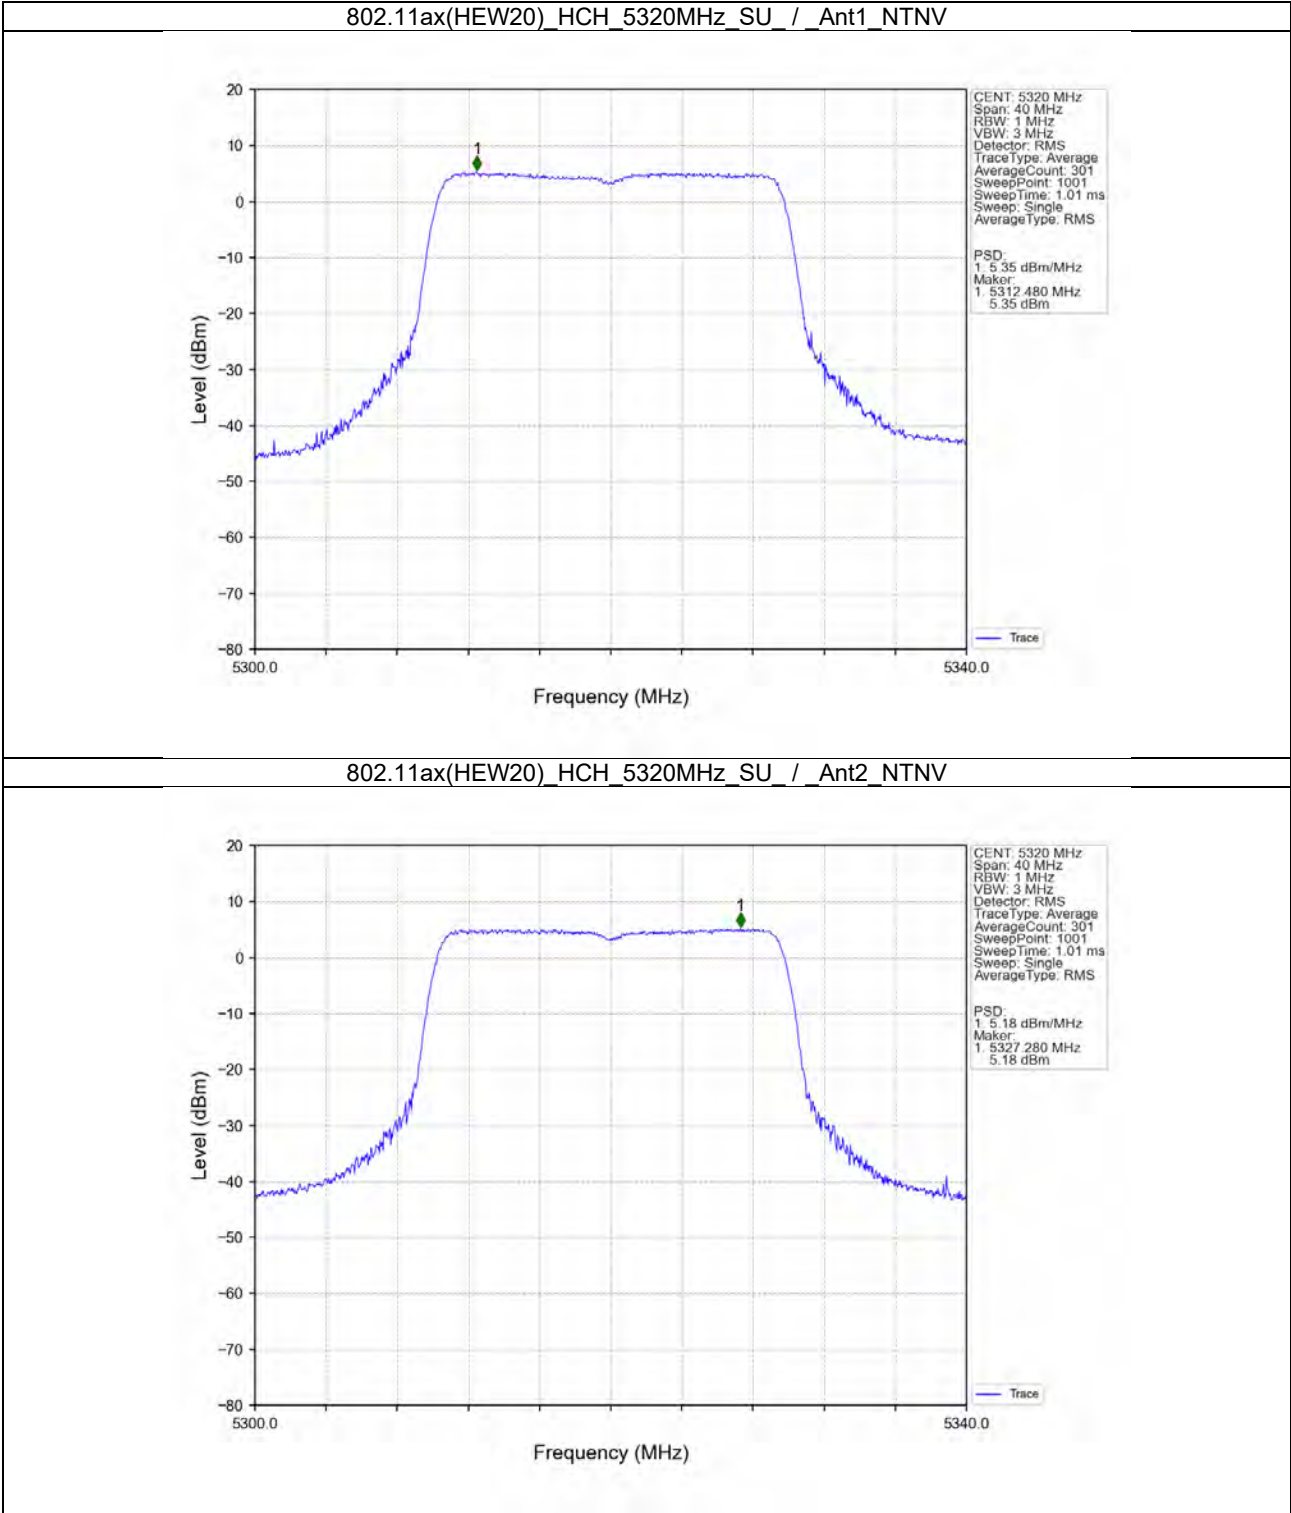



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 406 of 1085

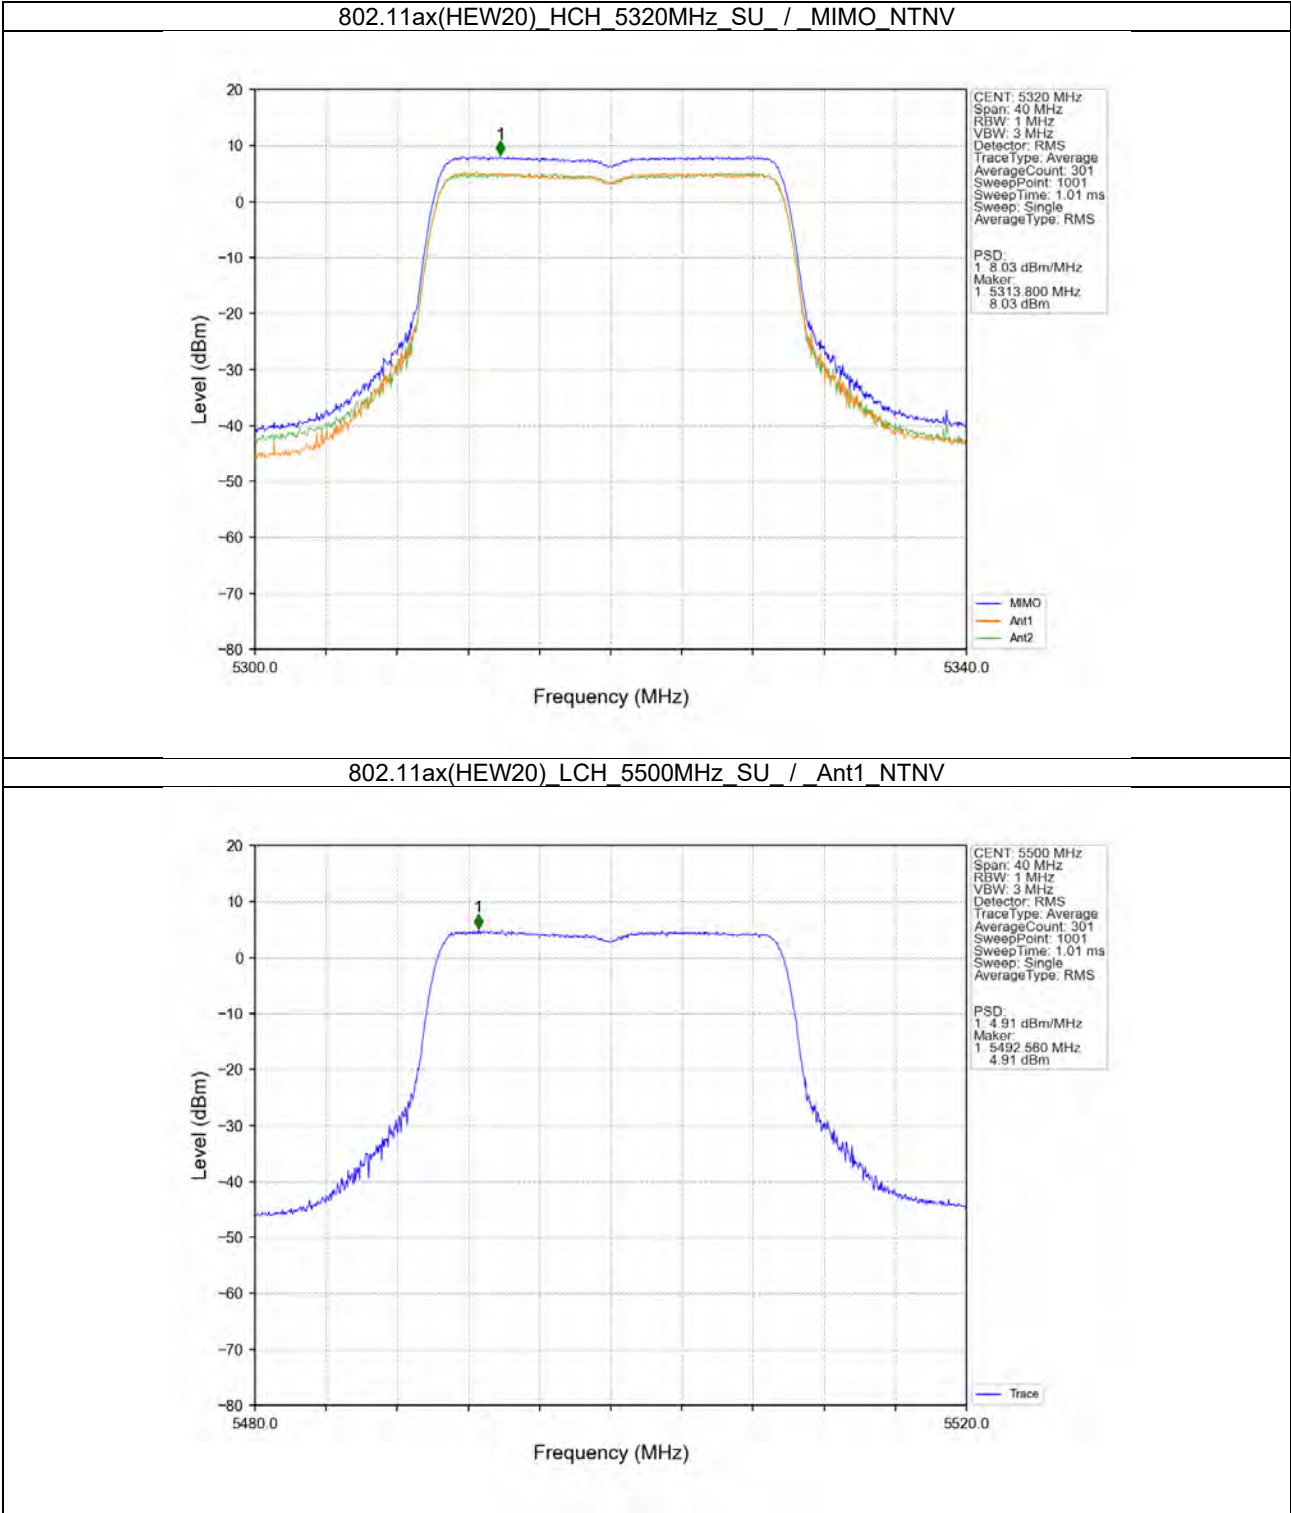



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 407 of 1085

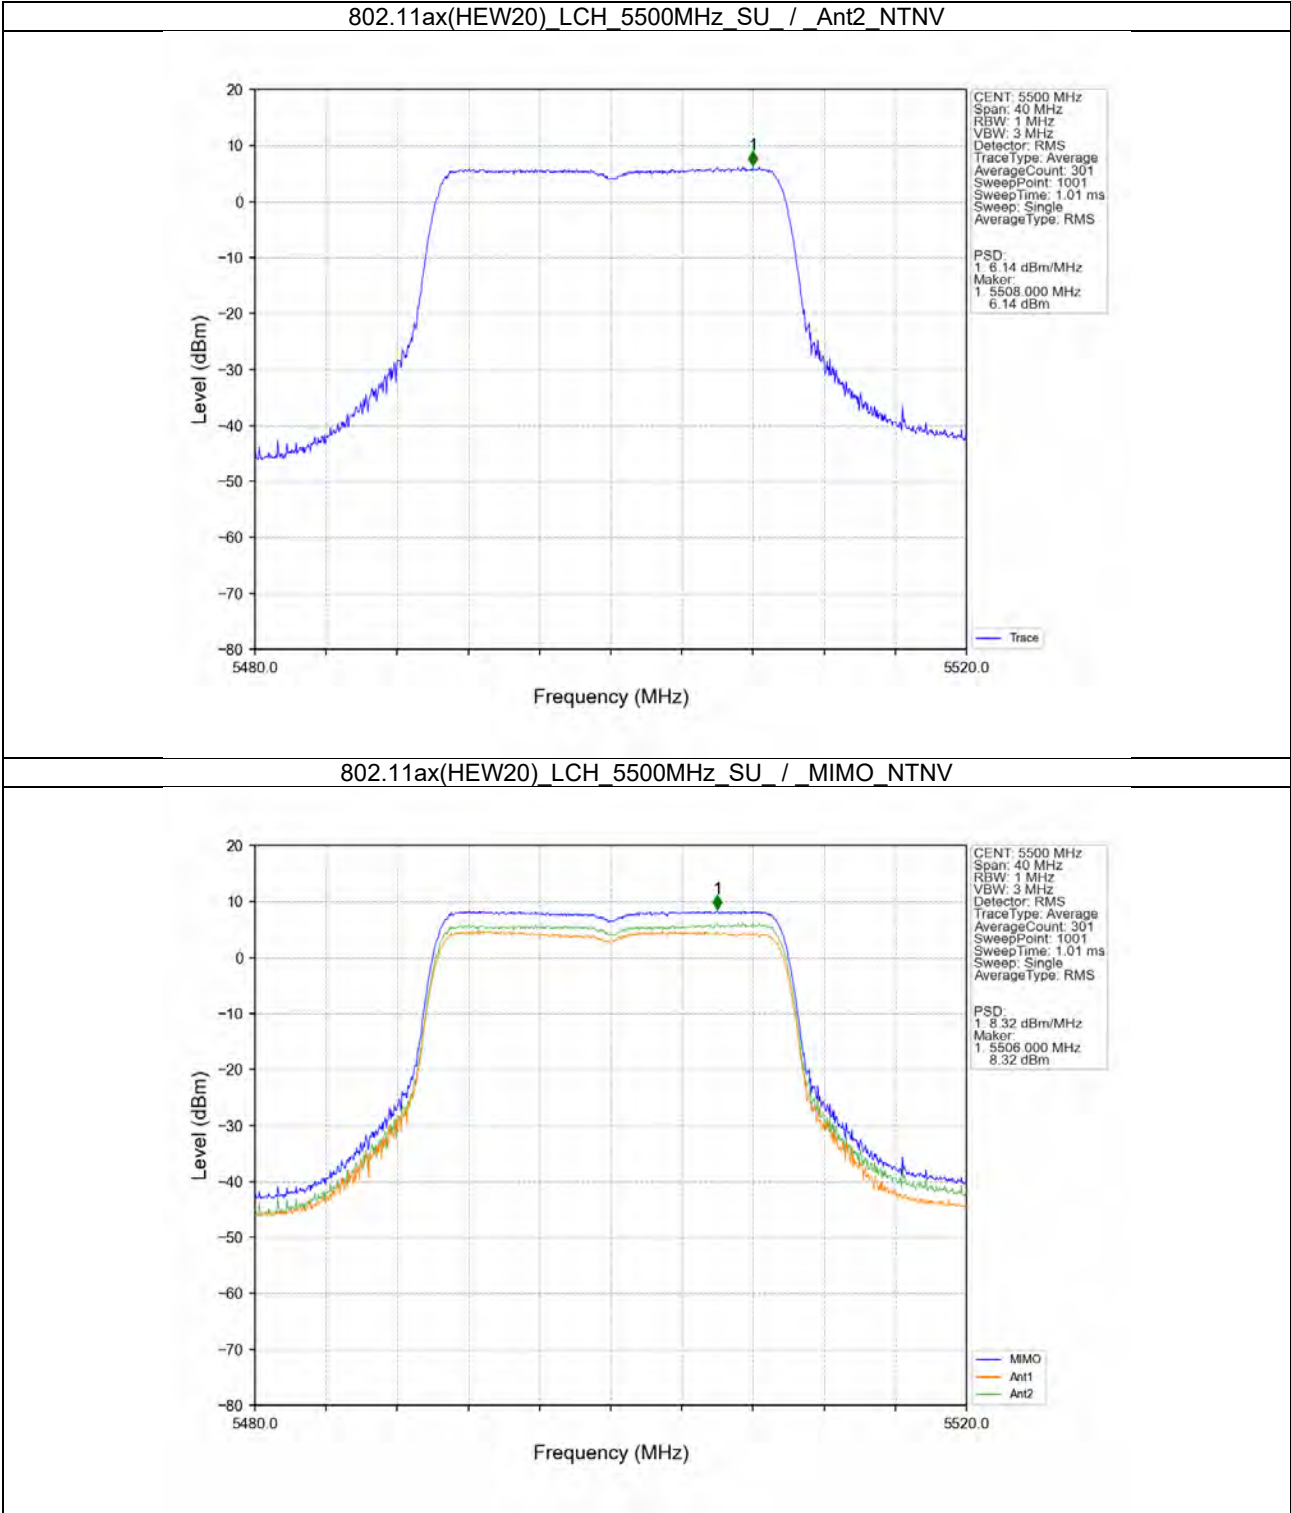




SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 408 of 1085

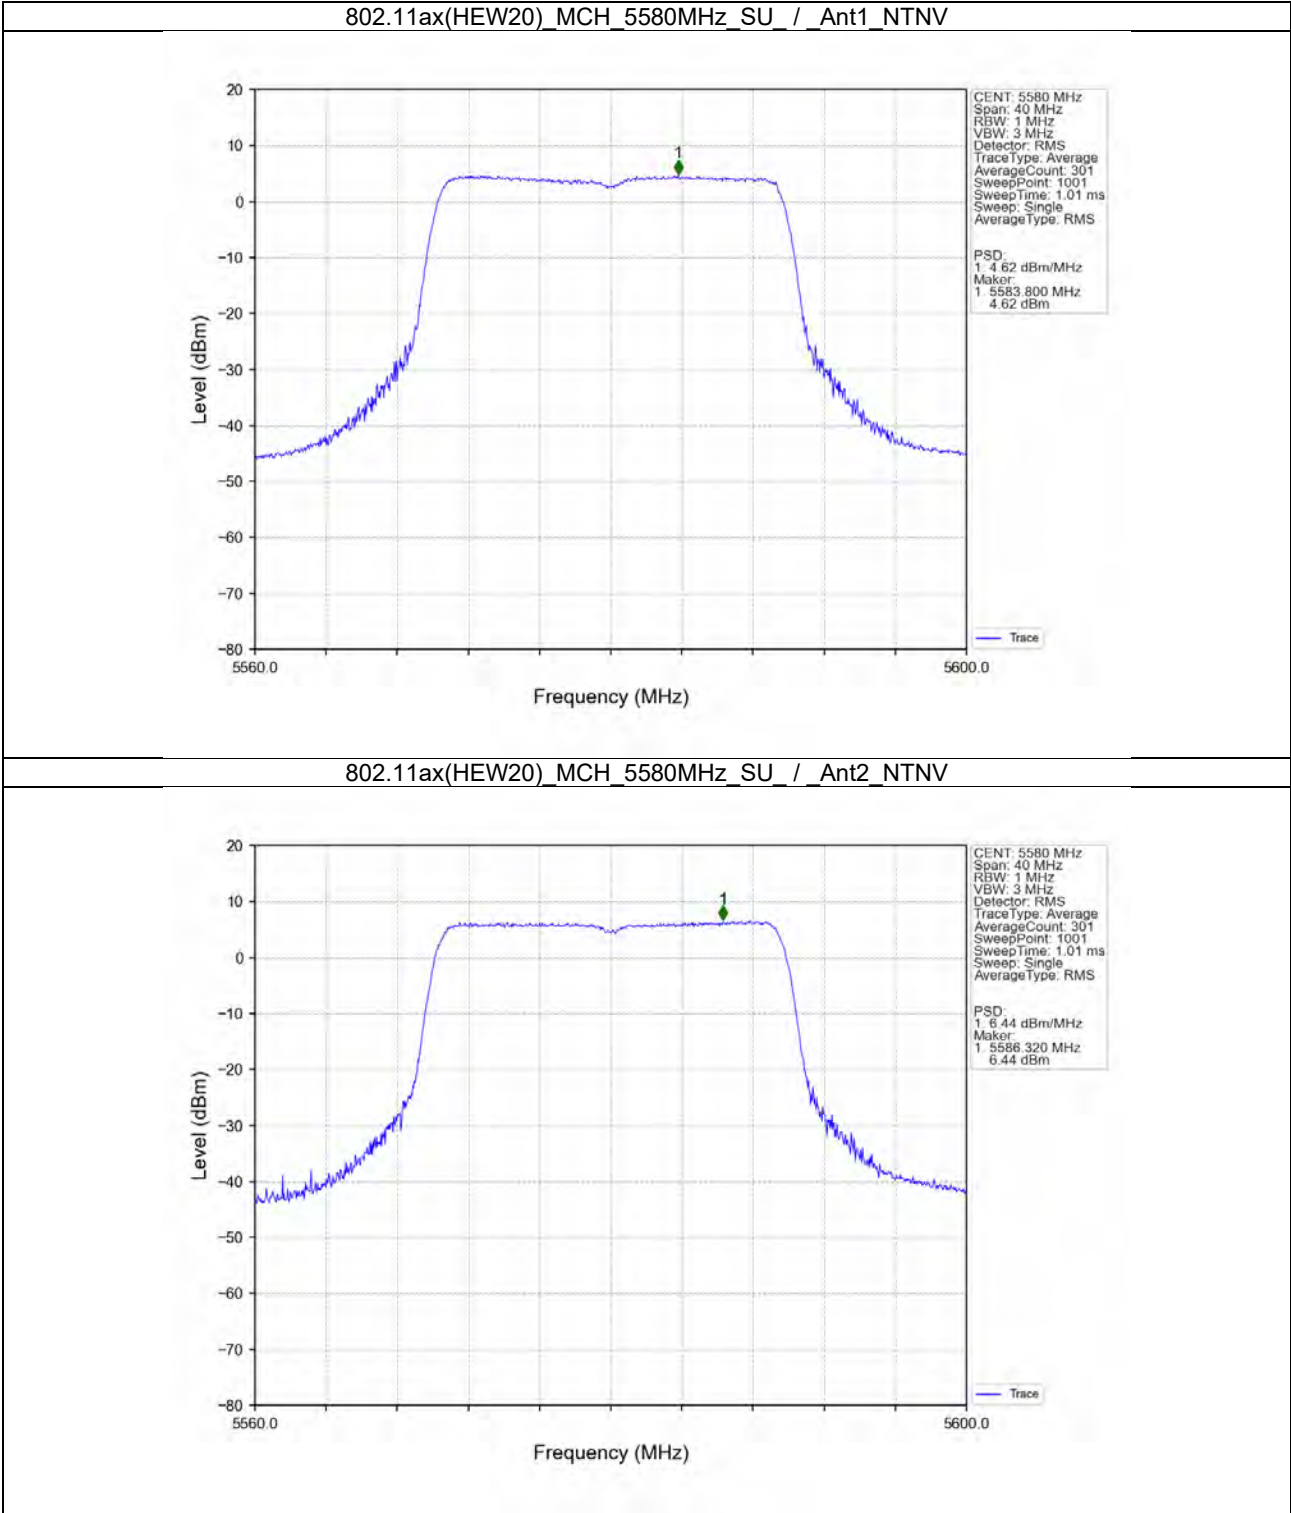

802.11ax(HEW20)_MCH_5580MHz_SU / _MIMO_NTNV

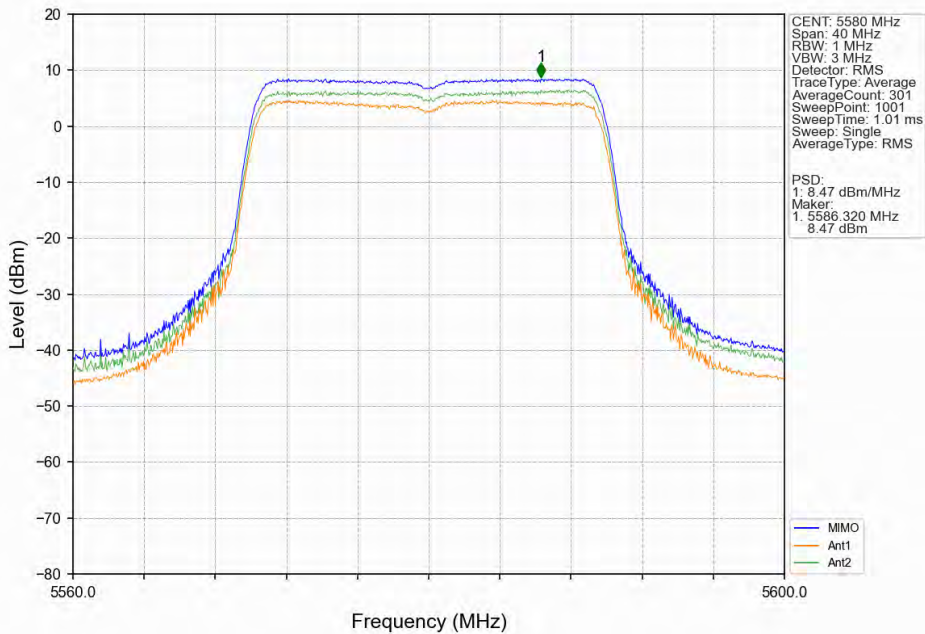


802.11ax(HEW20)_HCH_5700MHz_SU / _Ant1_NTNV

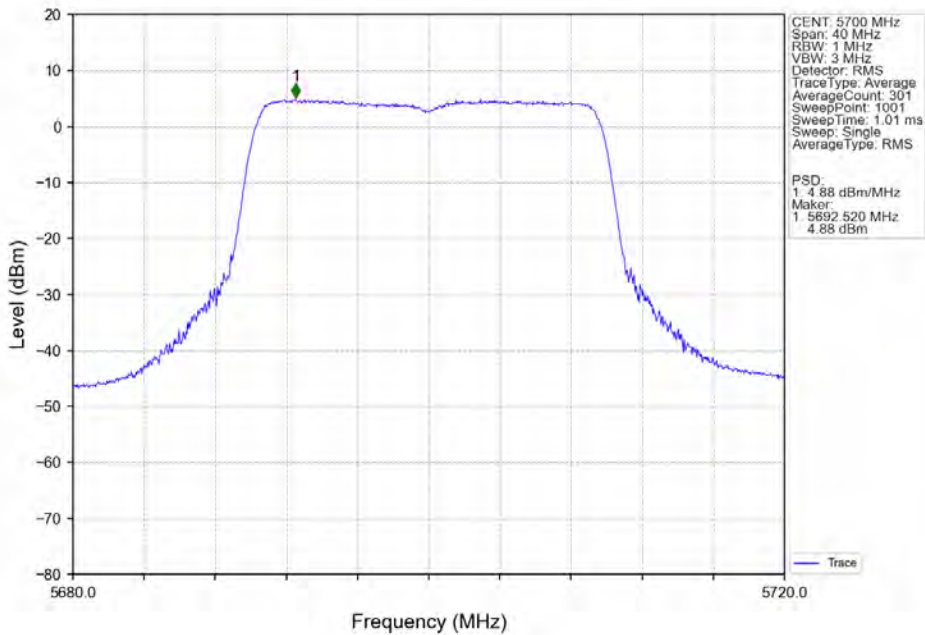



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 410 of 1085

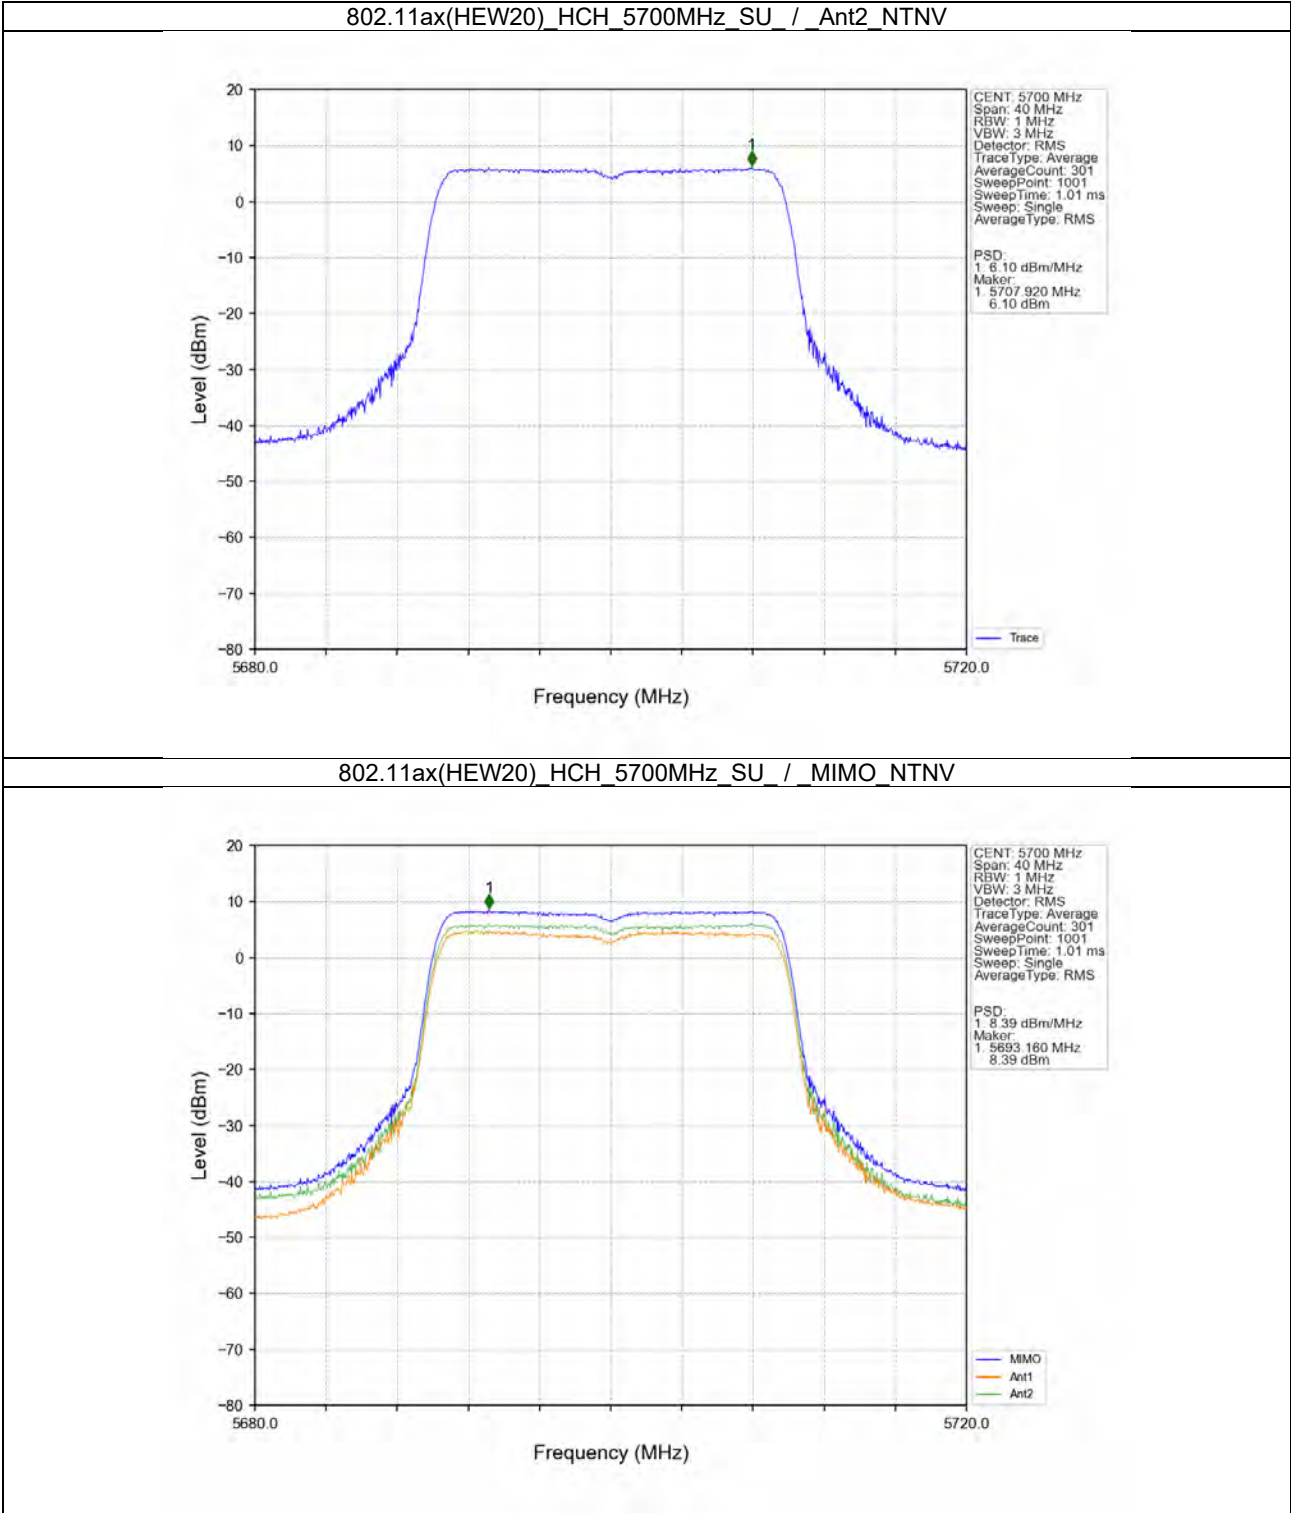




SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 411 of 1085

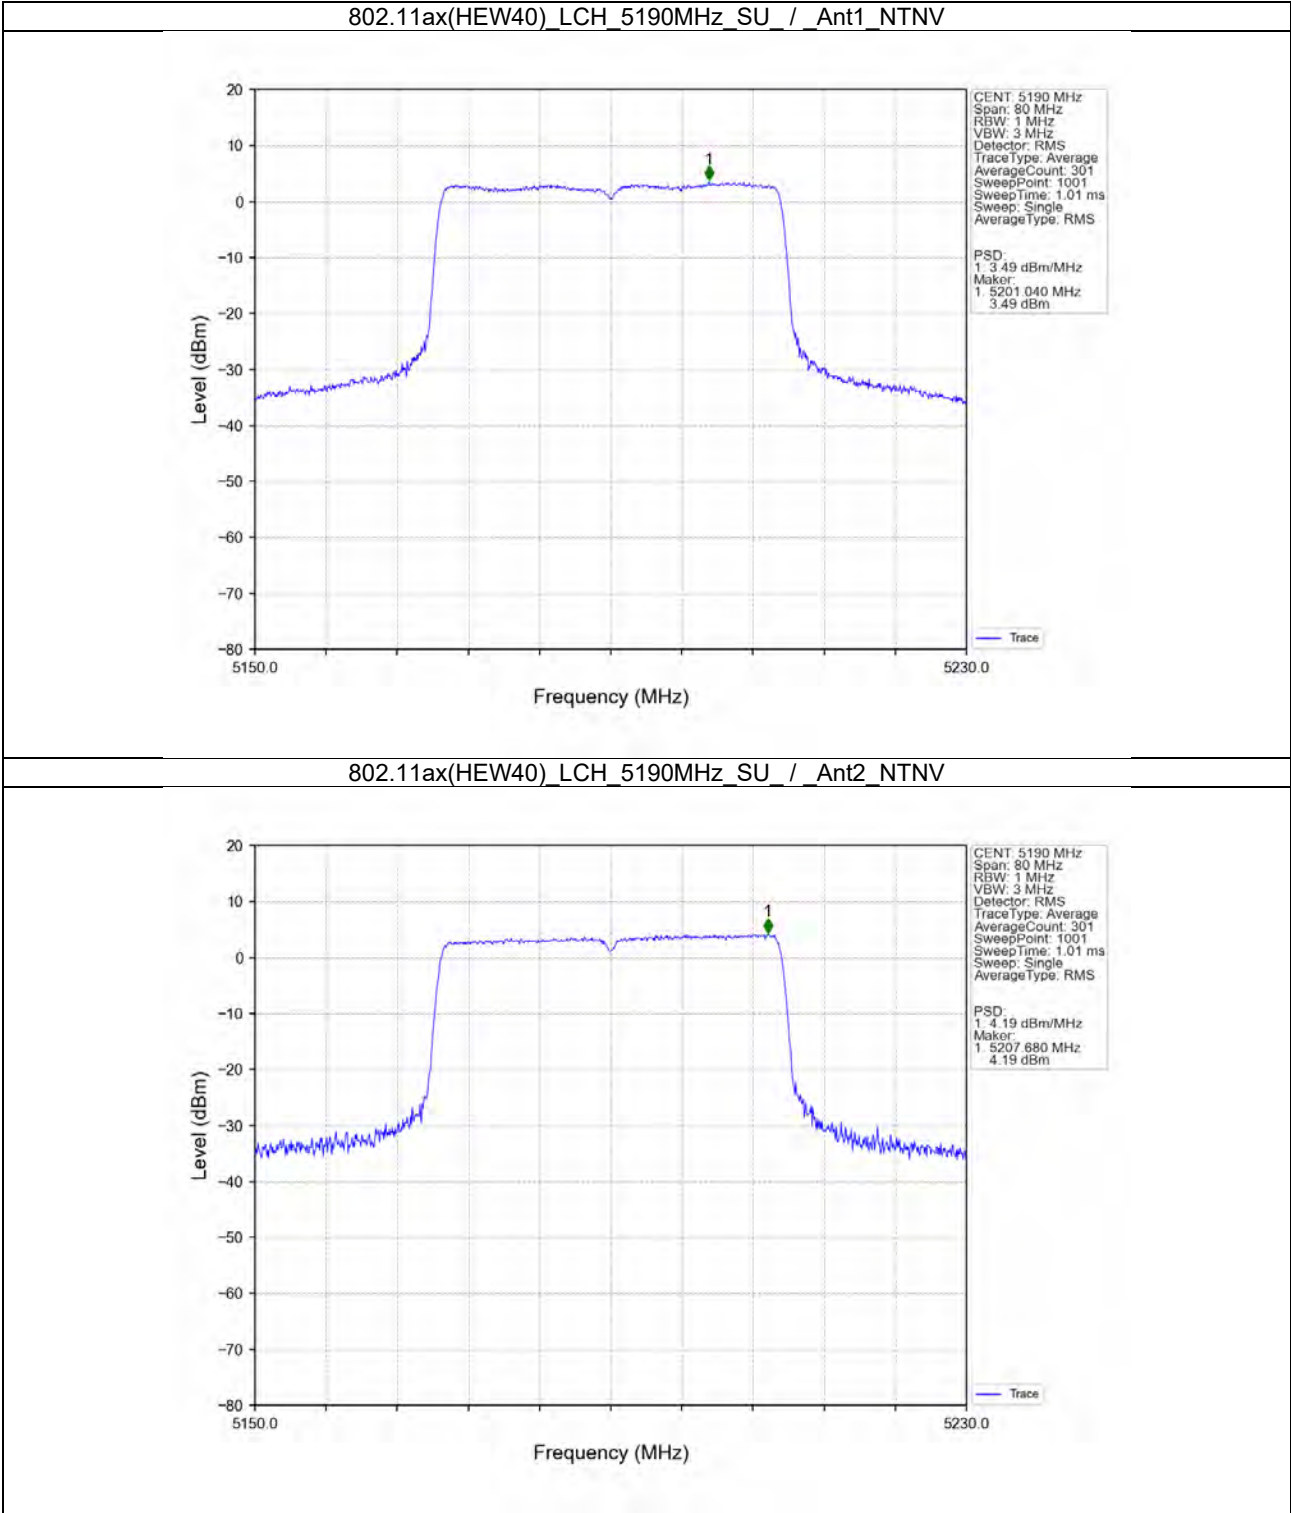

802.11ax(HEW40) LCH_5190MHz_SU / MIMO_NTNV

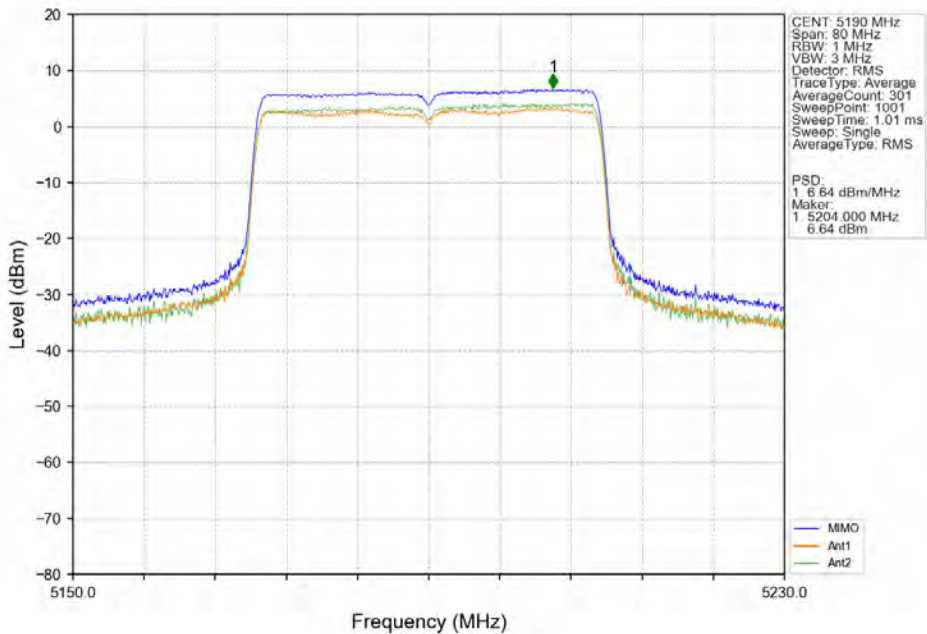


802.11ax(HEW40) HCH_5230MHz_SU / Ant1_NTNV

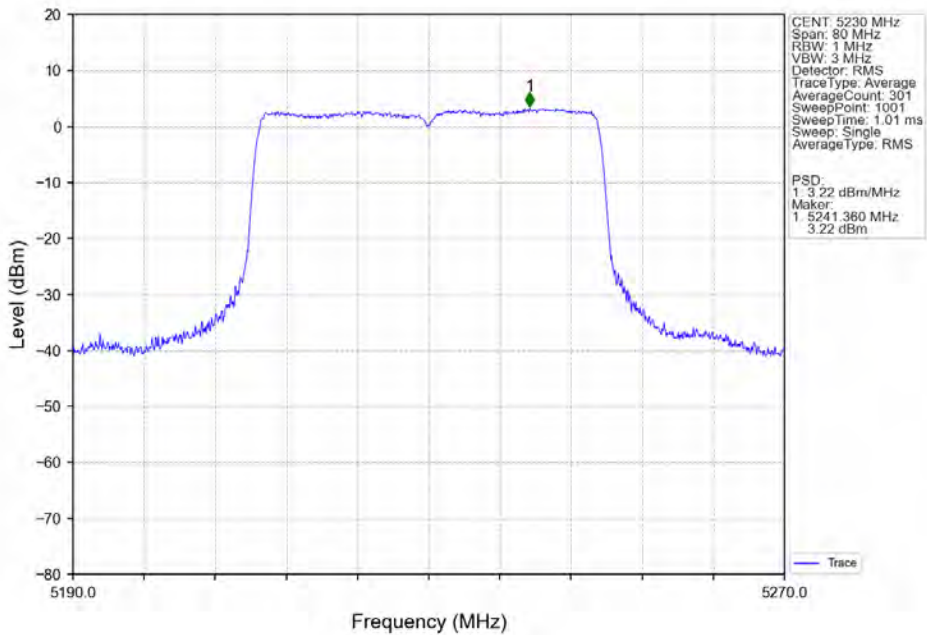



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 413 of 1085

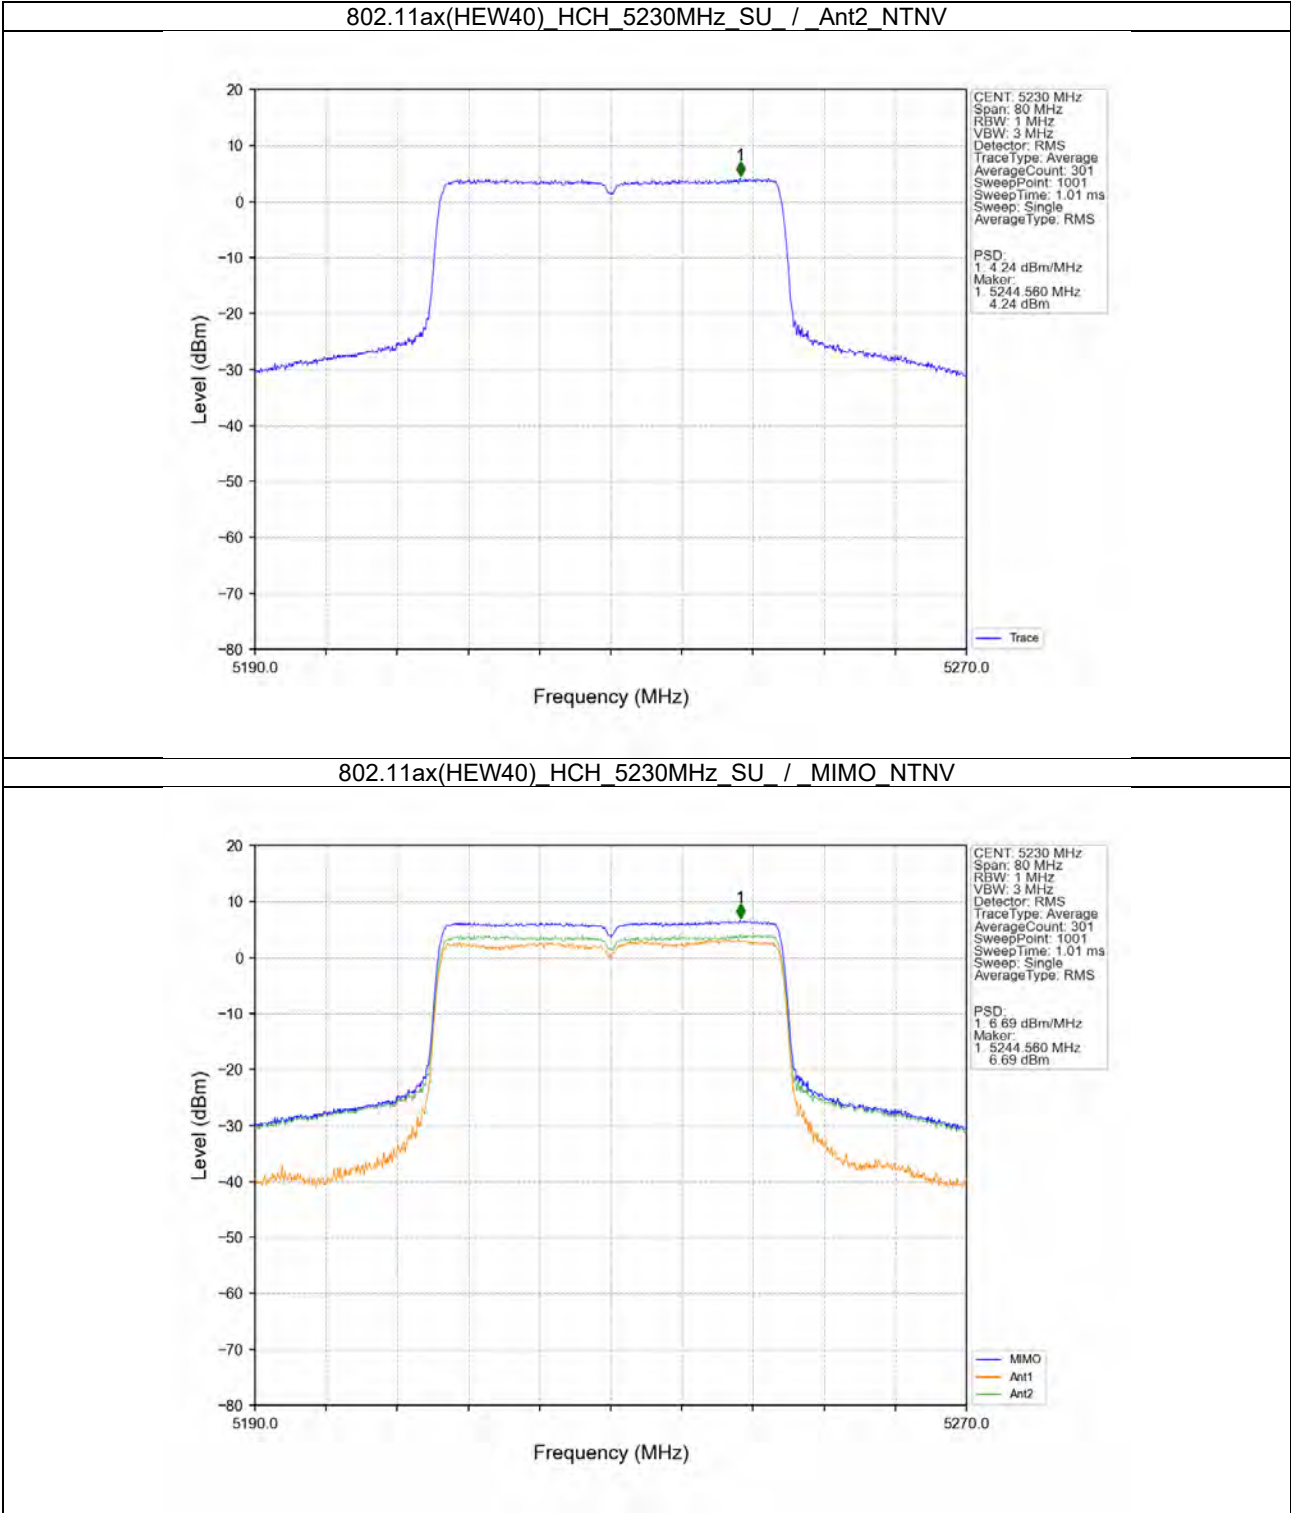




SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 414 of 1085

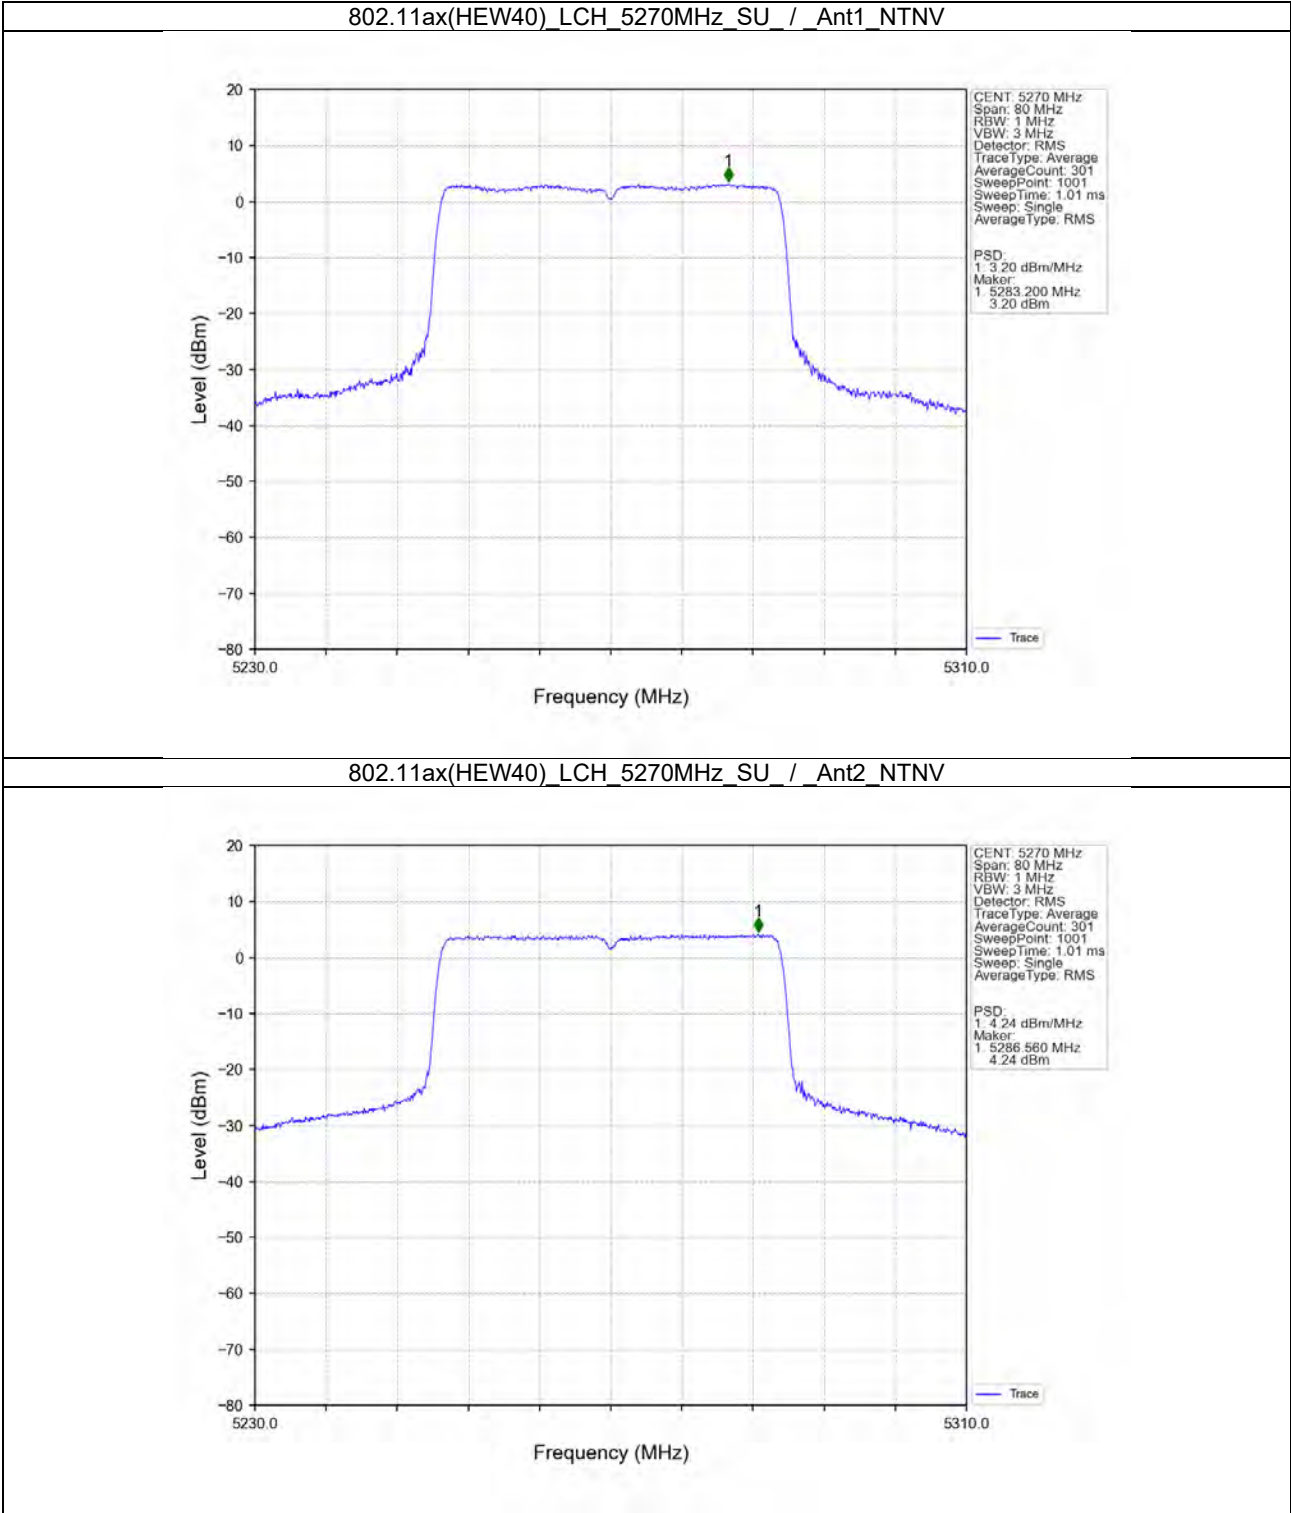


802.11ax(HEW40) LCH_5270MHz_SU / MIMO_NTNV

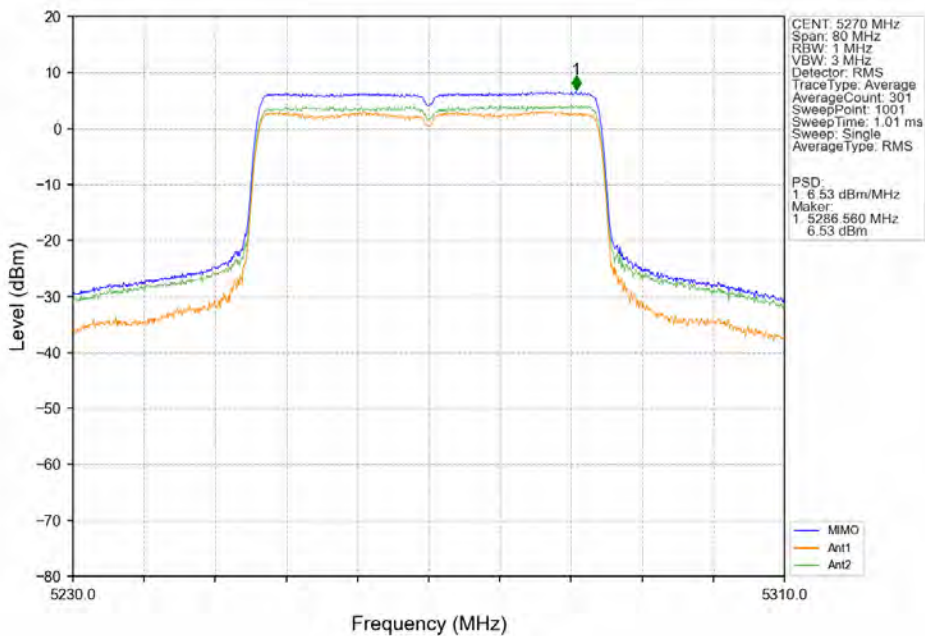


802.11ax(HEW40) HCH_5310MHz_SU / Ant1_NTNV

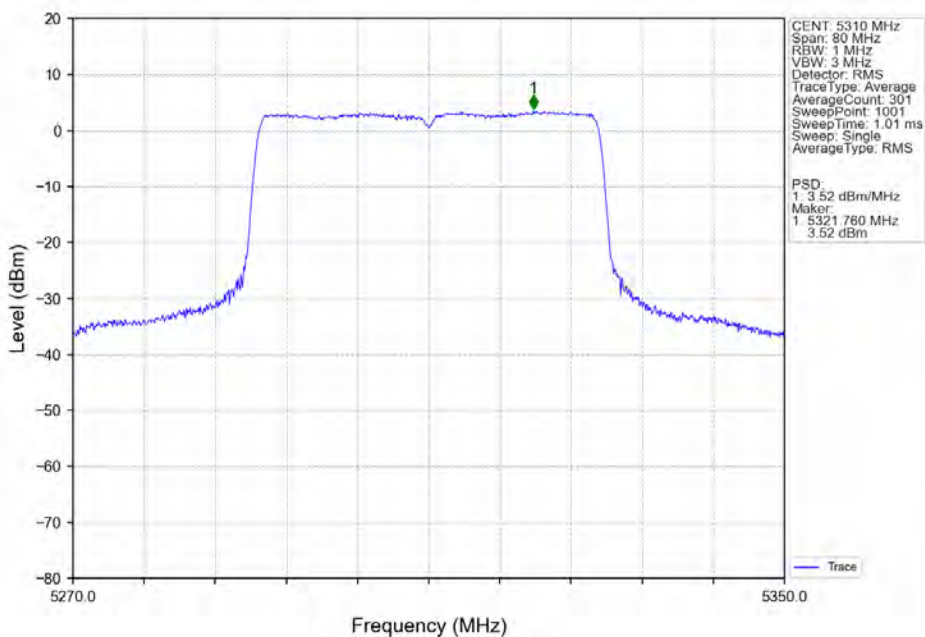

802.11ax(HEW40)_HCH_5310MHz_SU / _Ant2_NTNV

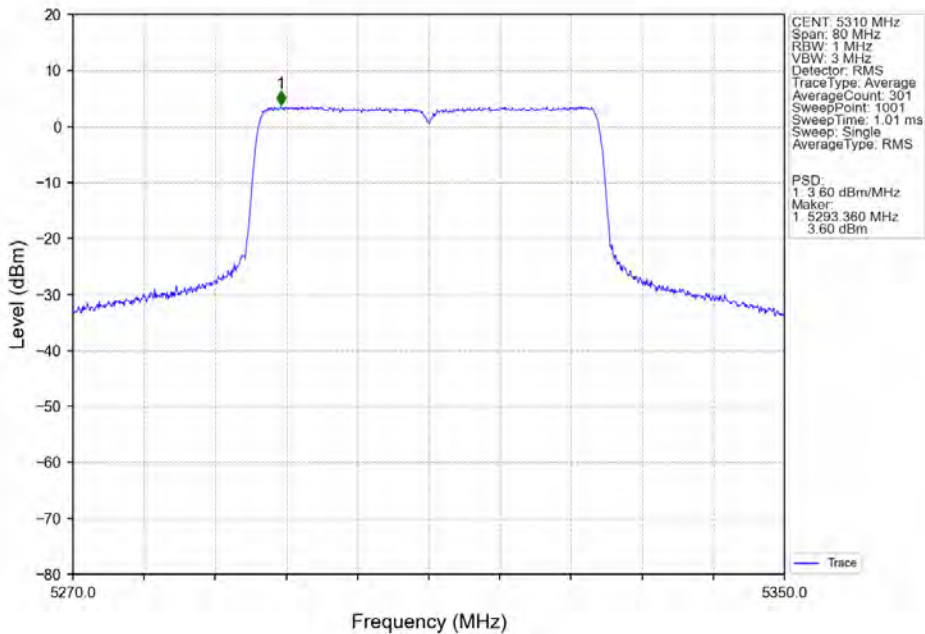

802.11ax(HEW40)_HCH_5310MHz_SU / _MIMO_NTNV

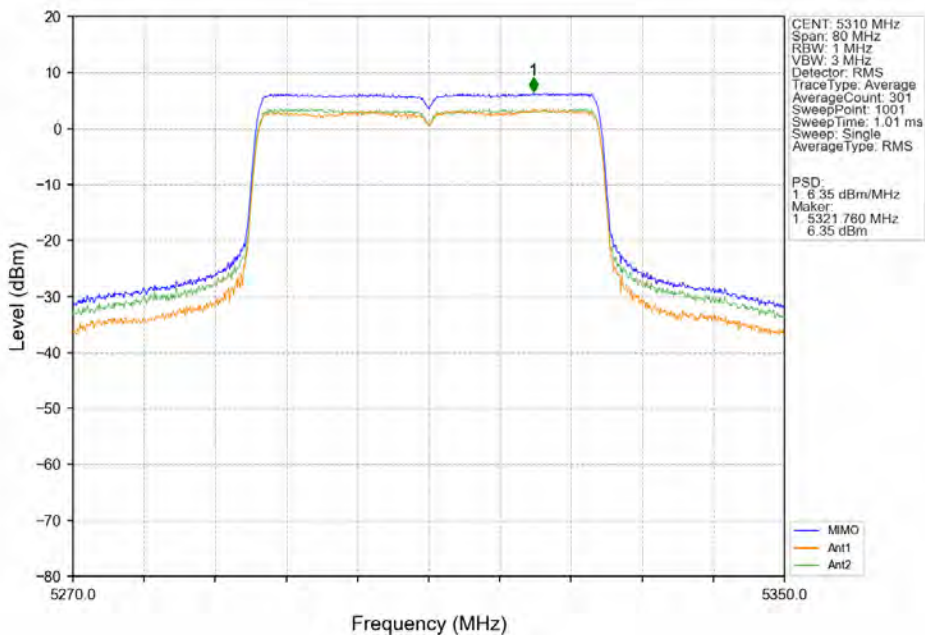





SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.

Report No.: SUCR250300017004
Rev.: 01
Page: 417 of 1085

802.11ax(HEW40)_LCH_5510MHz_SU_/_Ant1_NTNV

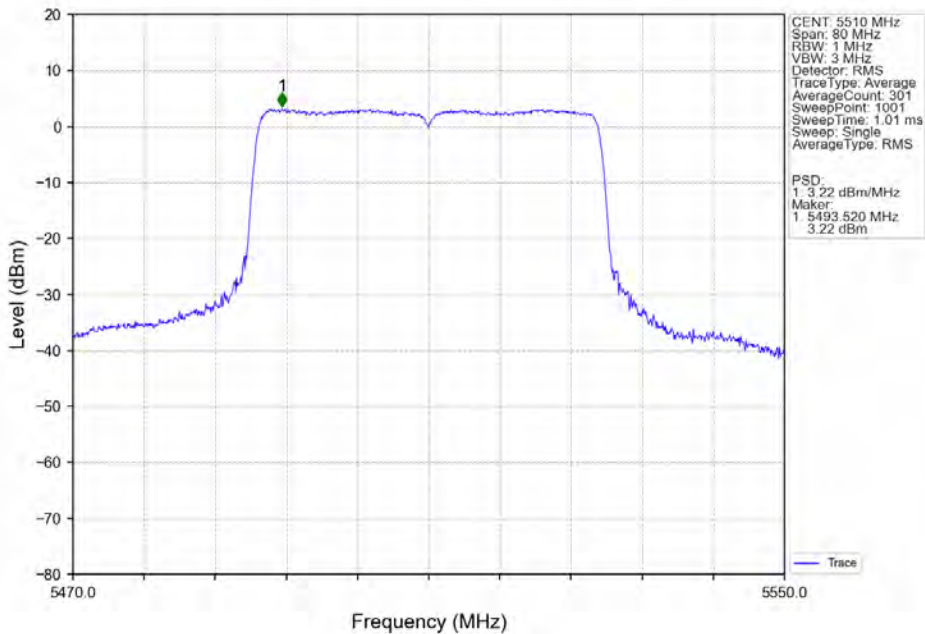


802.11ax(HEW40)_LCH_5510MHz_SU_/_Ant2_NTNV

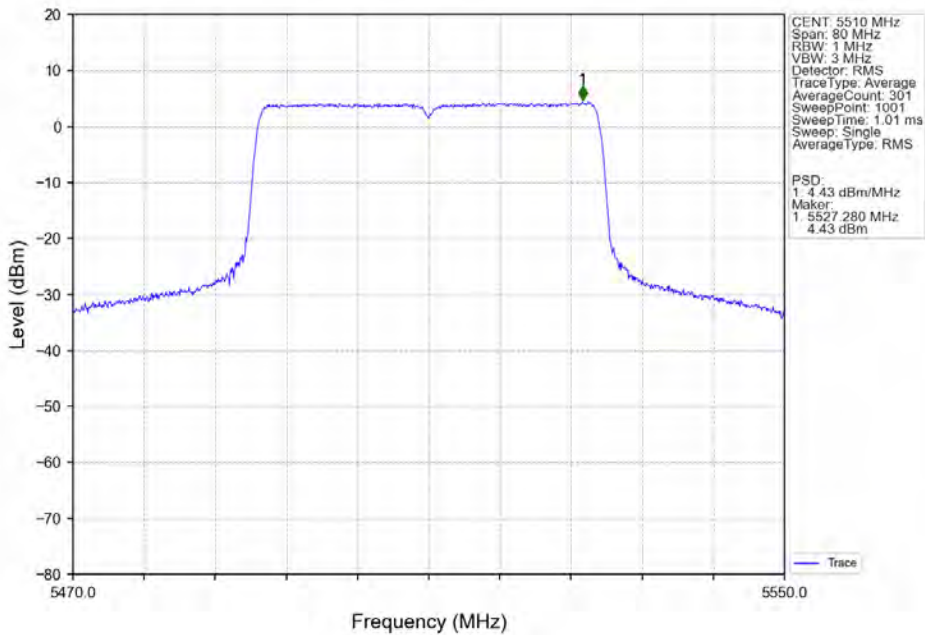



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.

Report No.: SUCR250300017004
Rev.: 01
Page: 418 of 1085

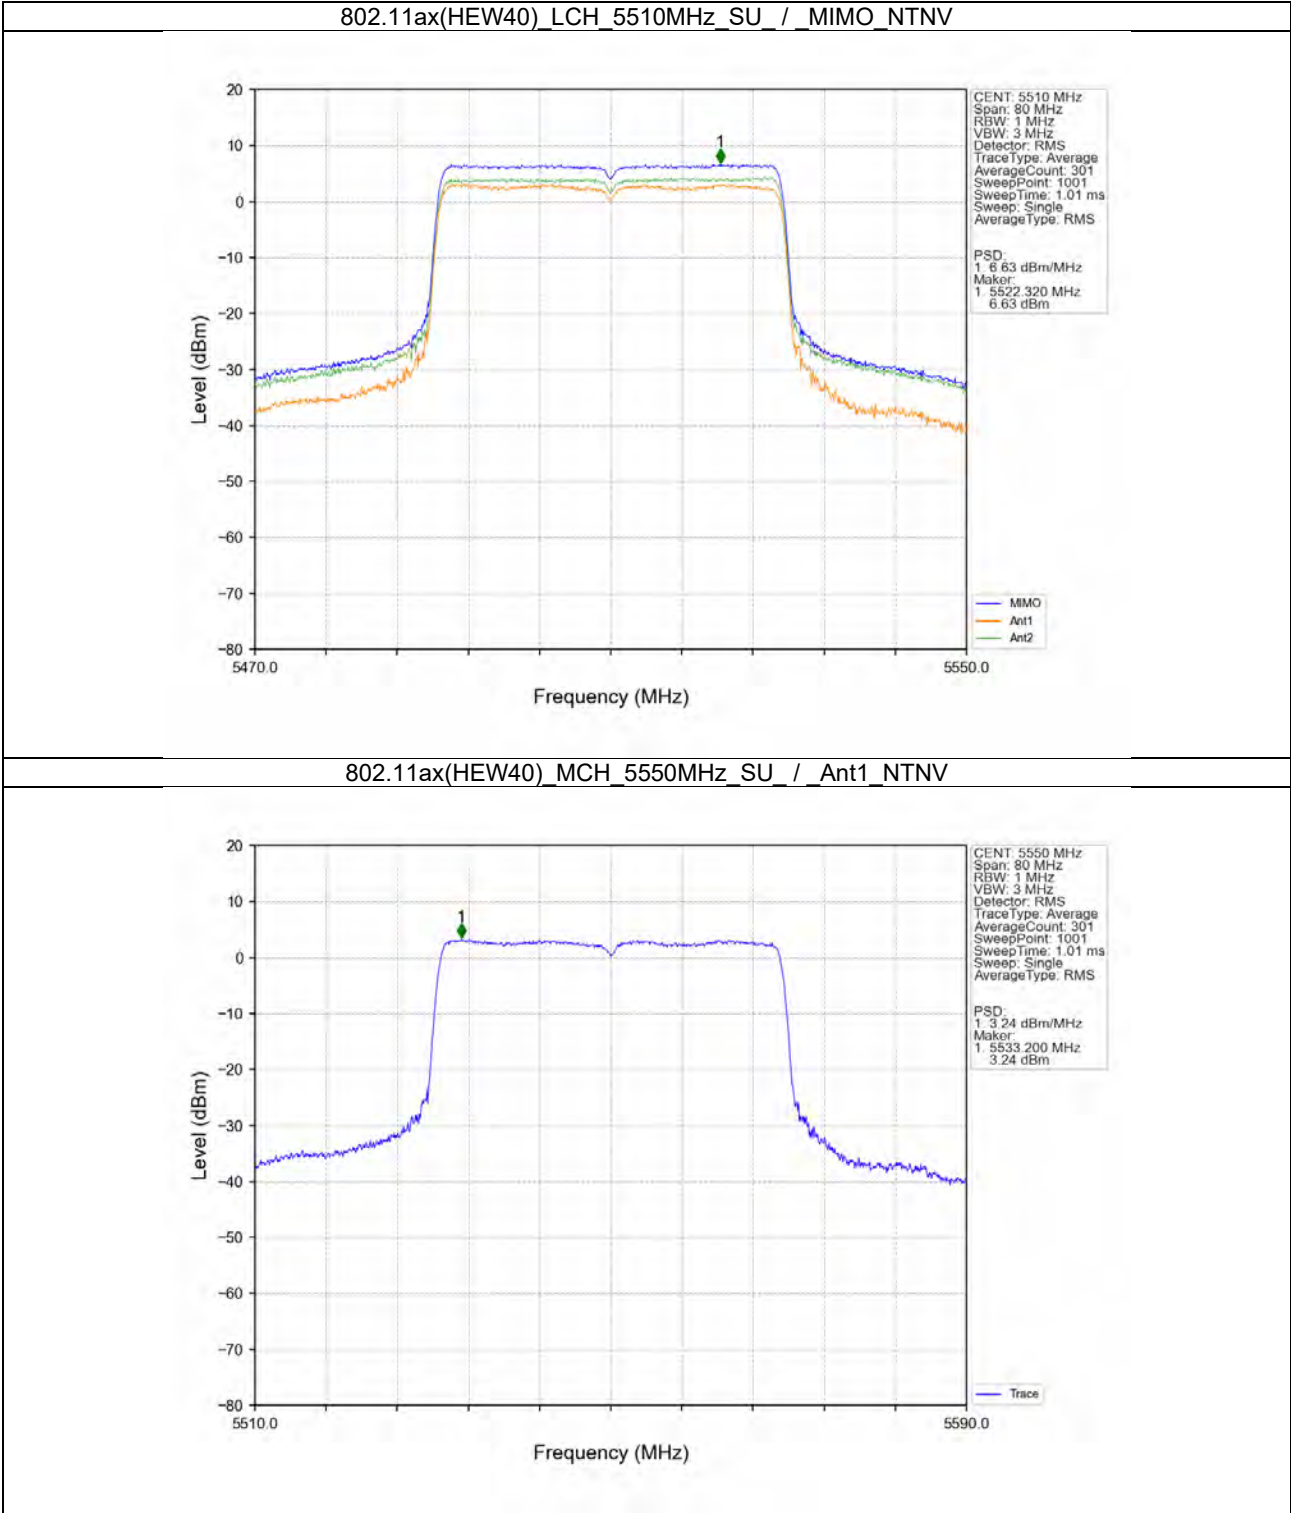





SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.

Report No.: SUCR250300017004
Rev.: 01
Page: 419 of 1085

802.11ax(HEW40)_MCH_5550MHz_SU_/_Ant2_NTNV

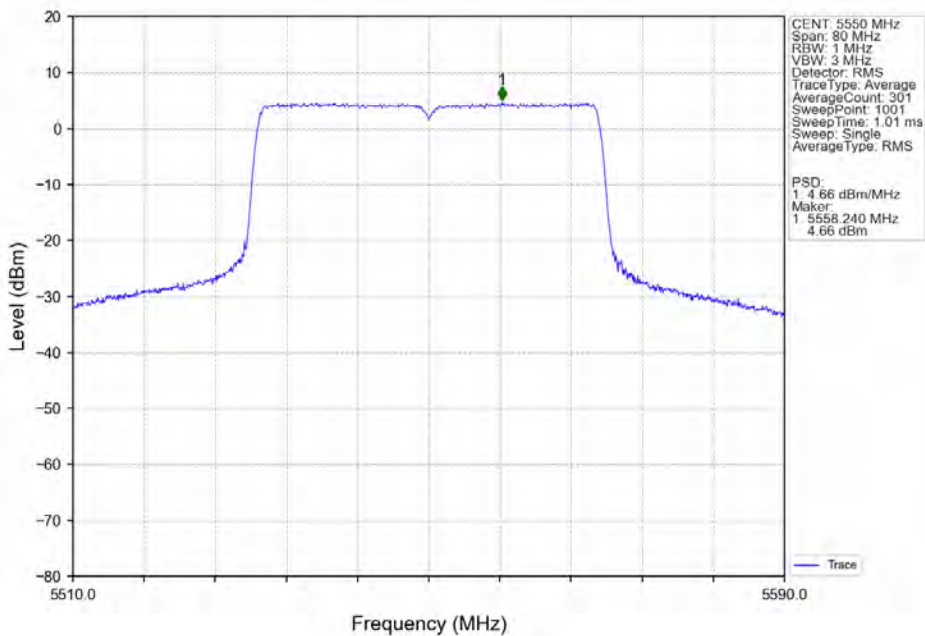


802.11ax(HEW40)_MCH_5550MHz_SU_/_MIMO_NTNV

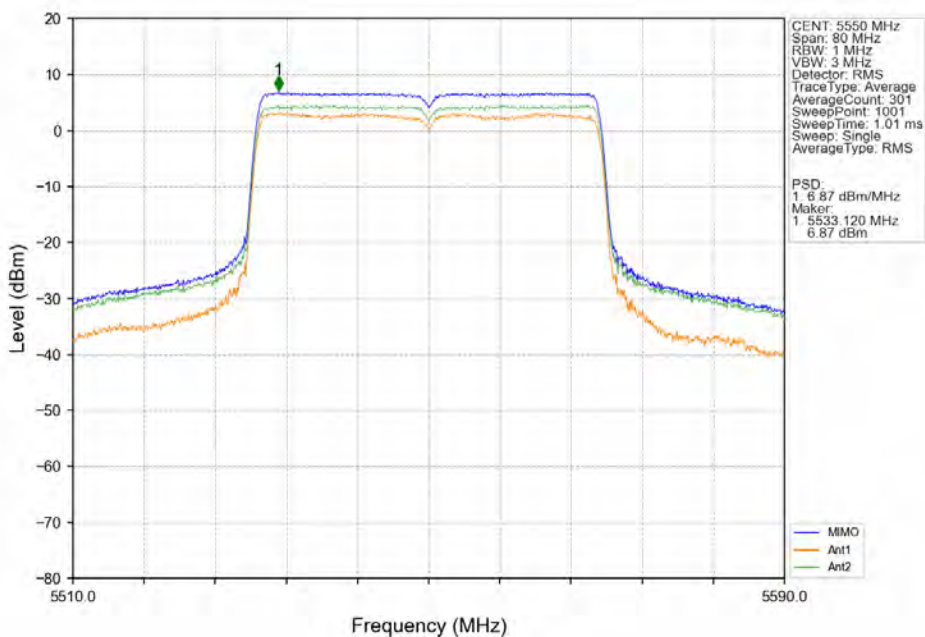



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 420 of 1085

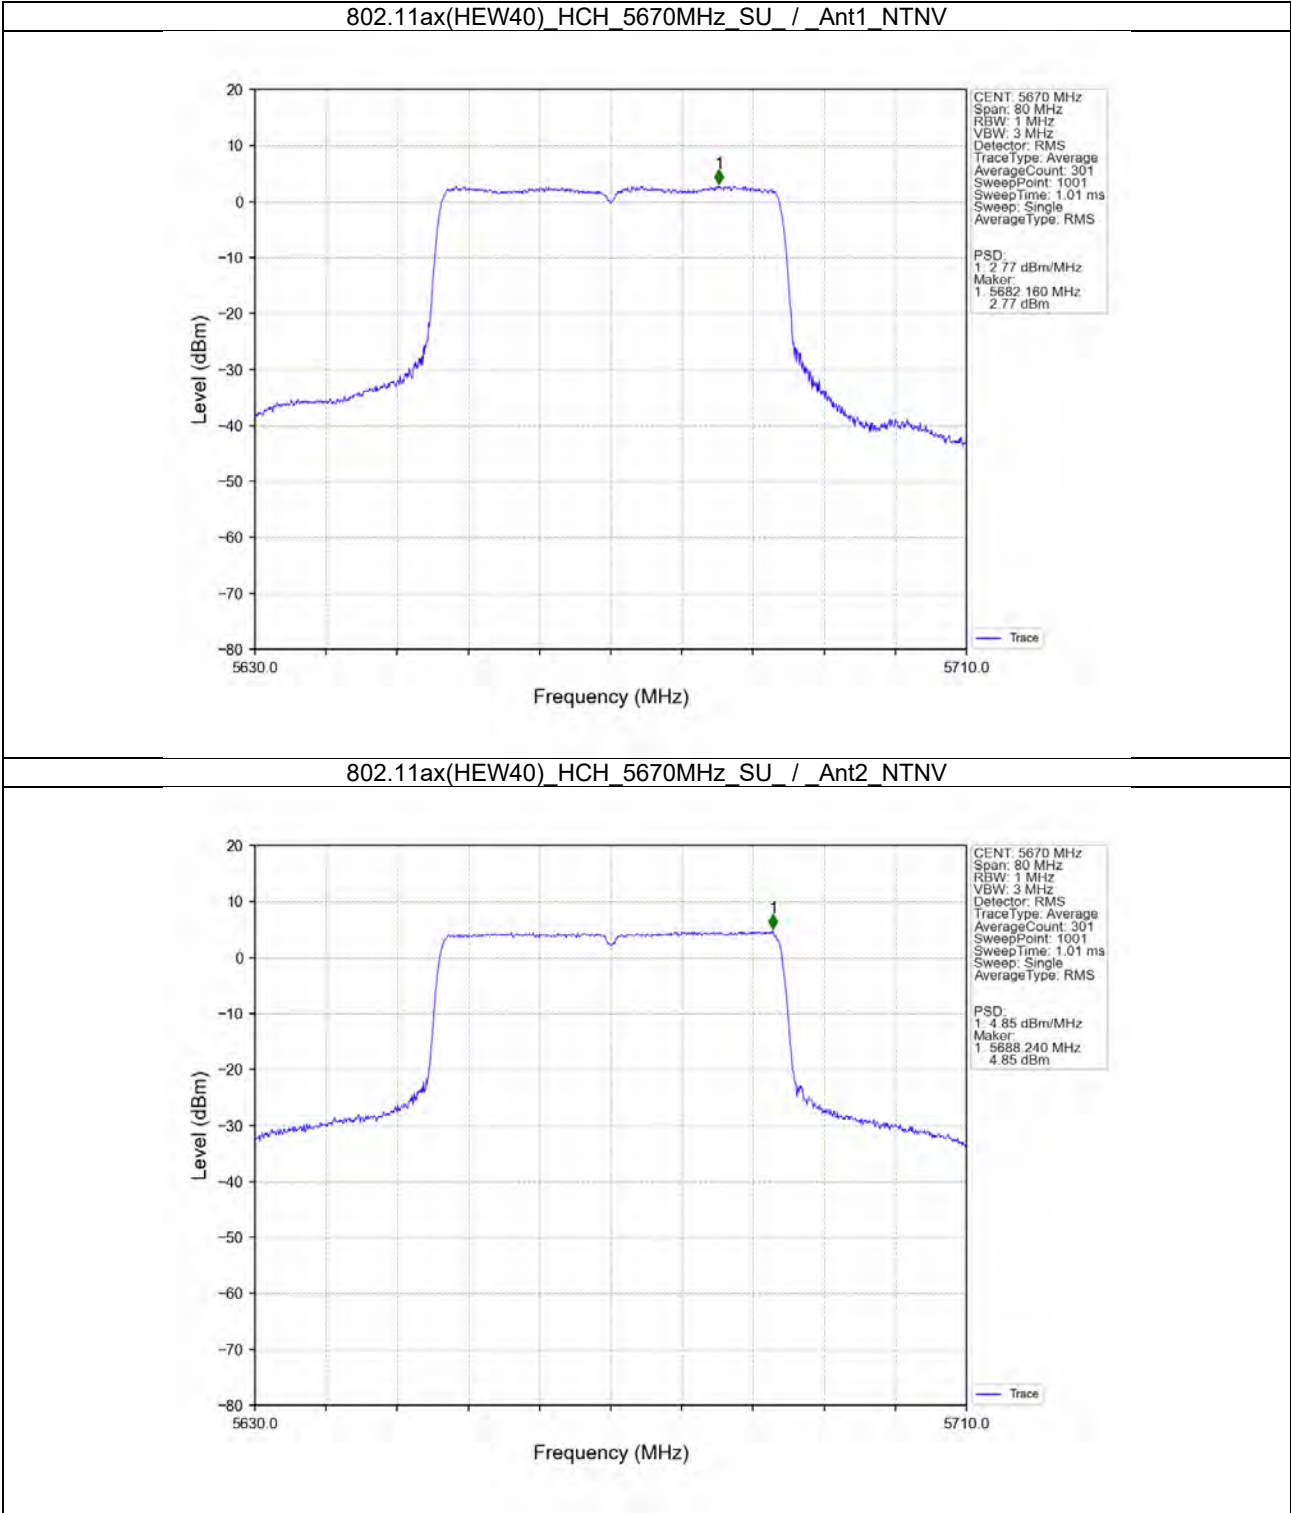



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 421 of 1085

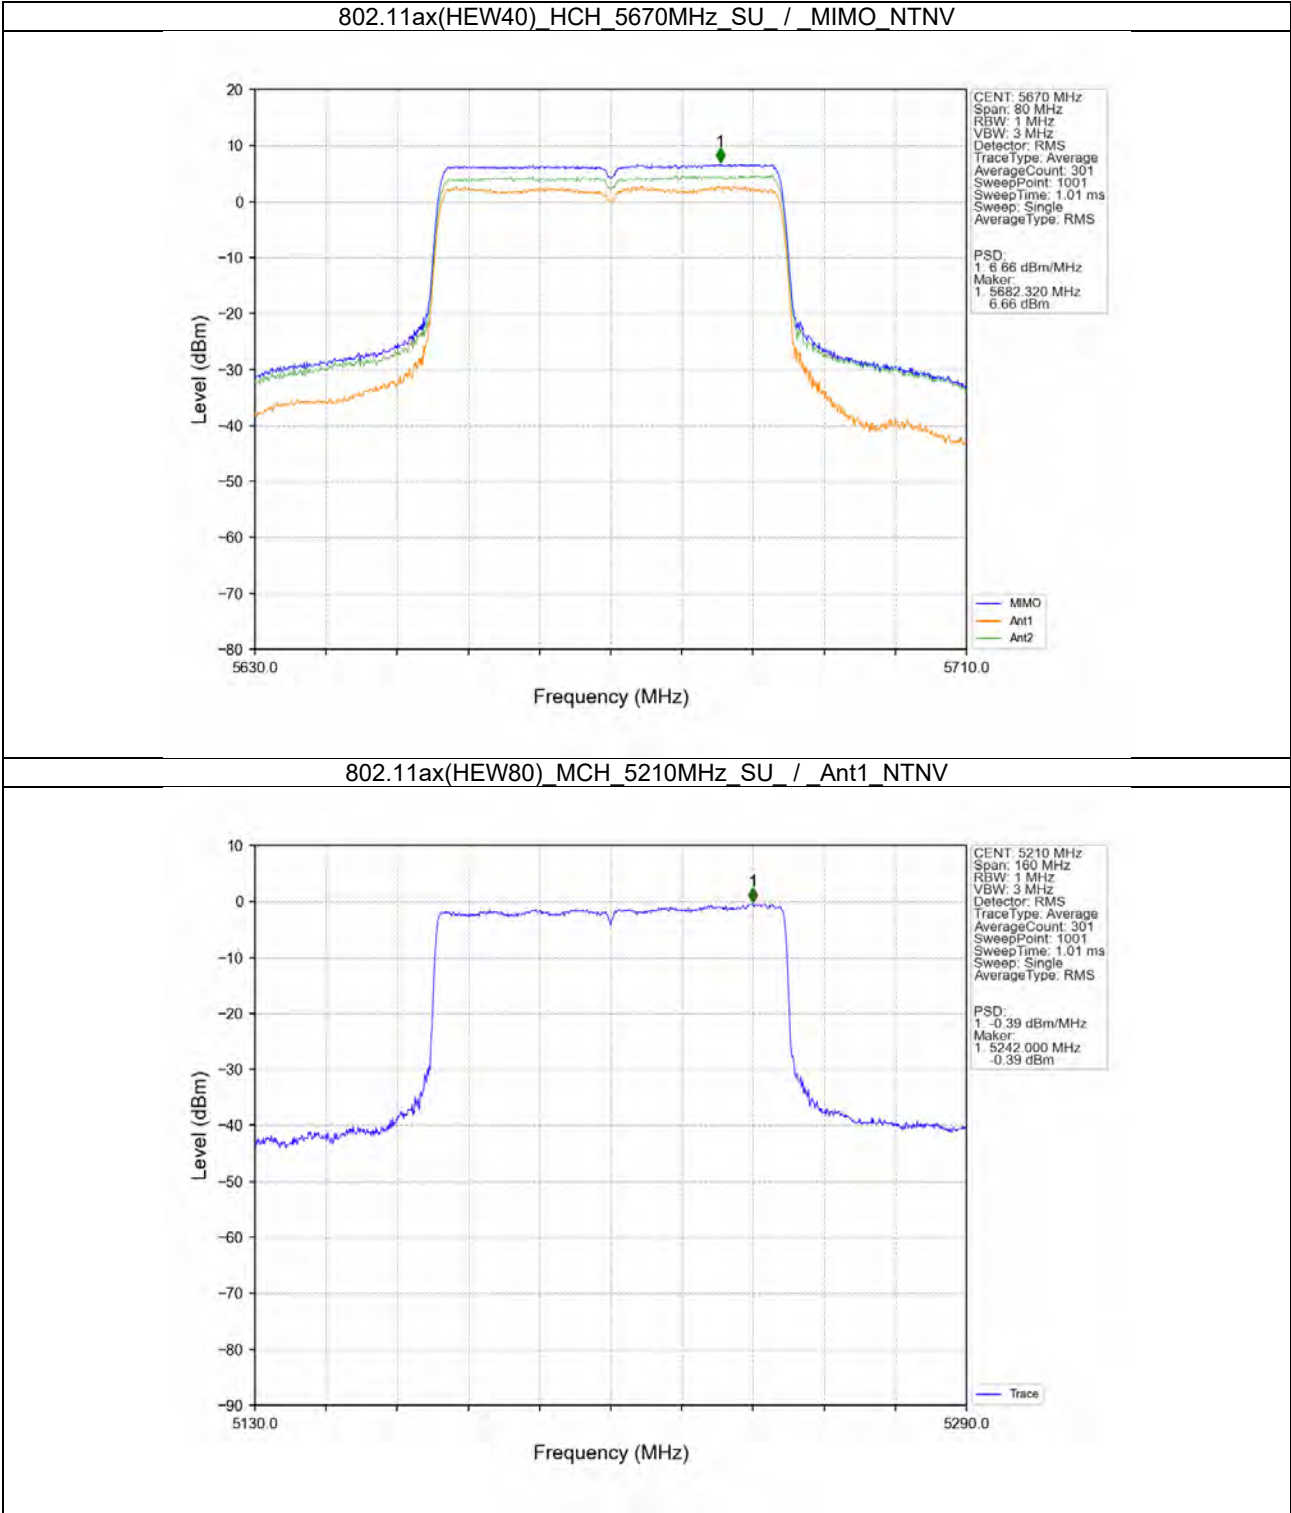



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 422 of 1085

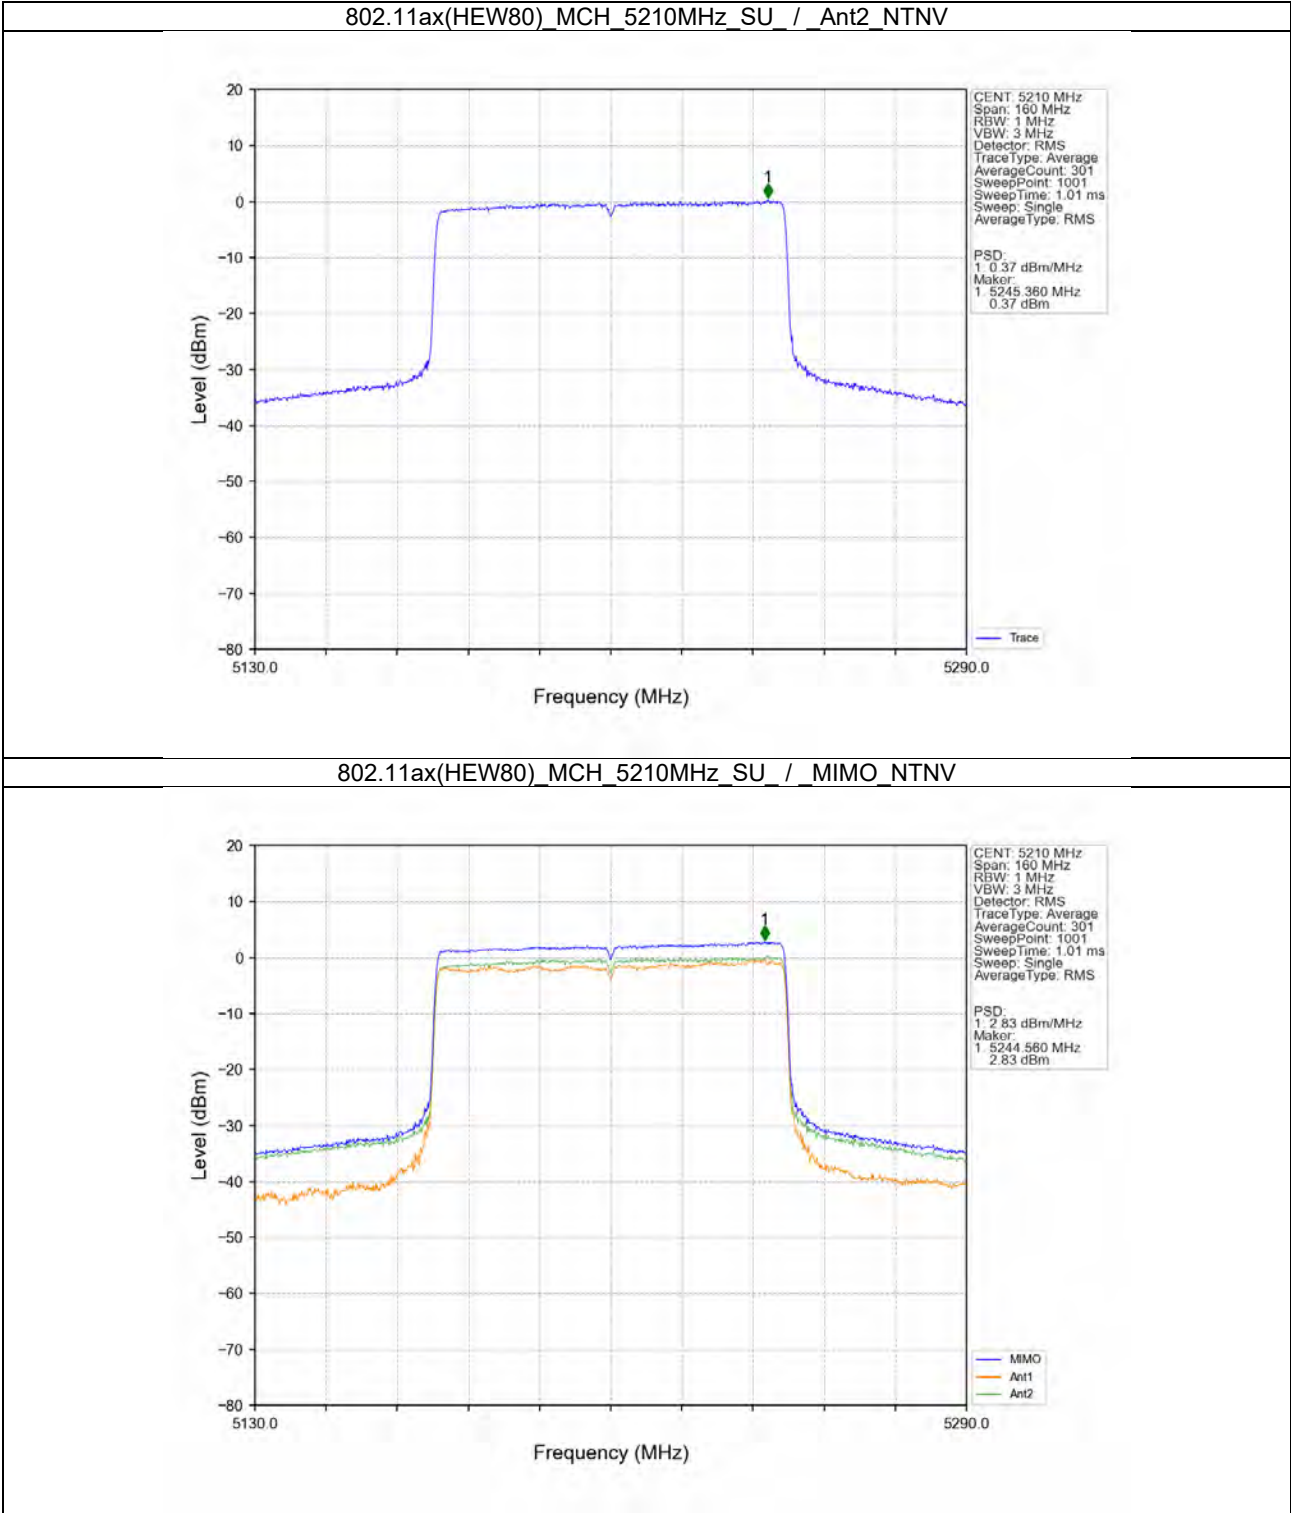



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 423 of 1085

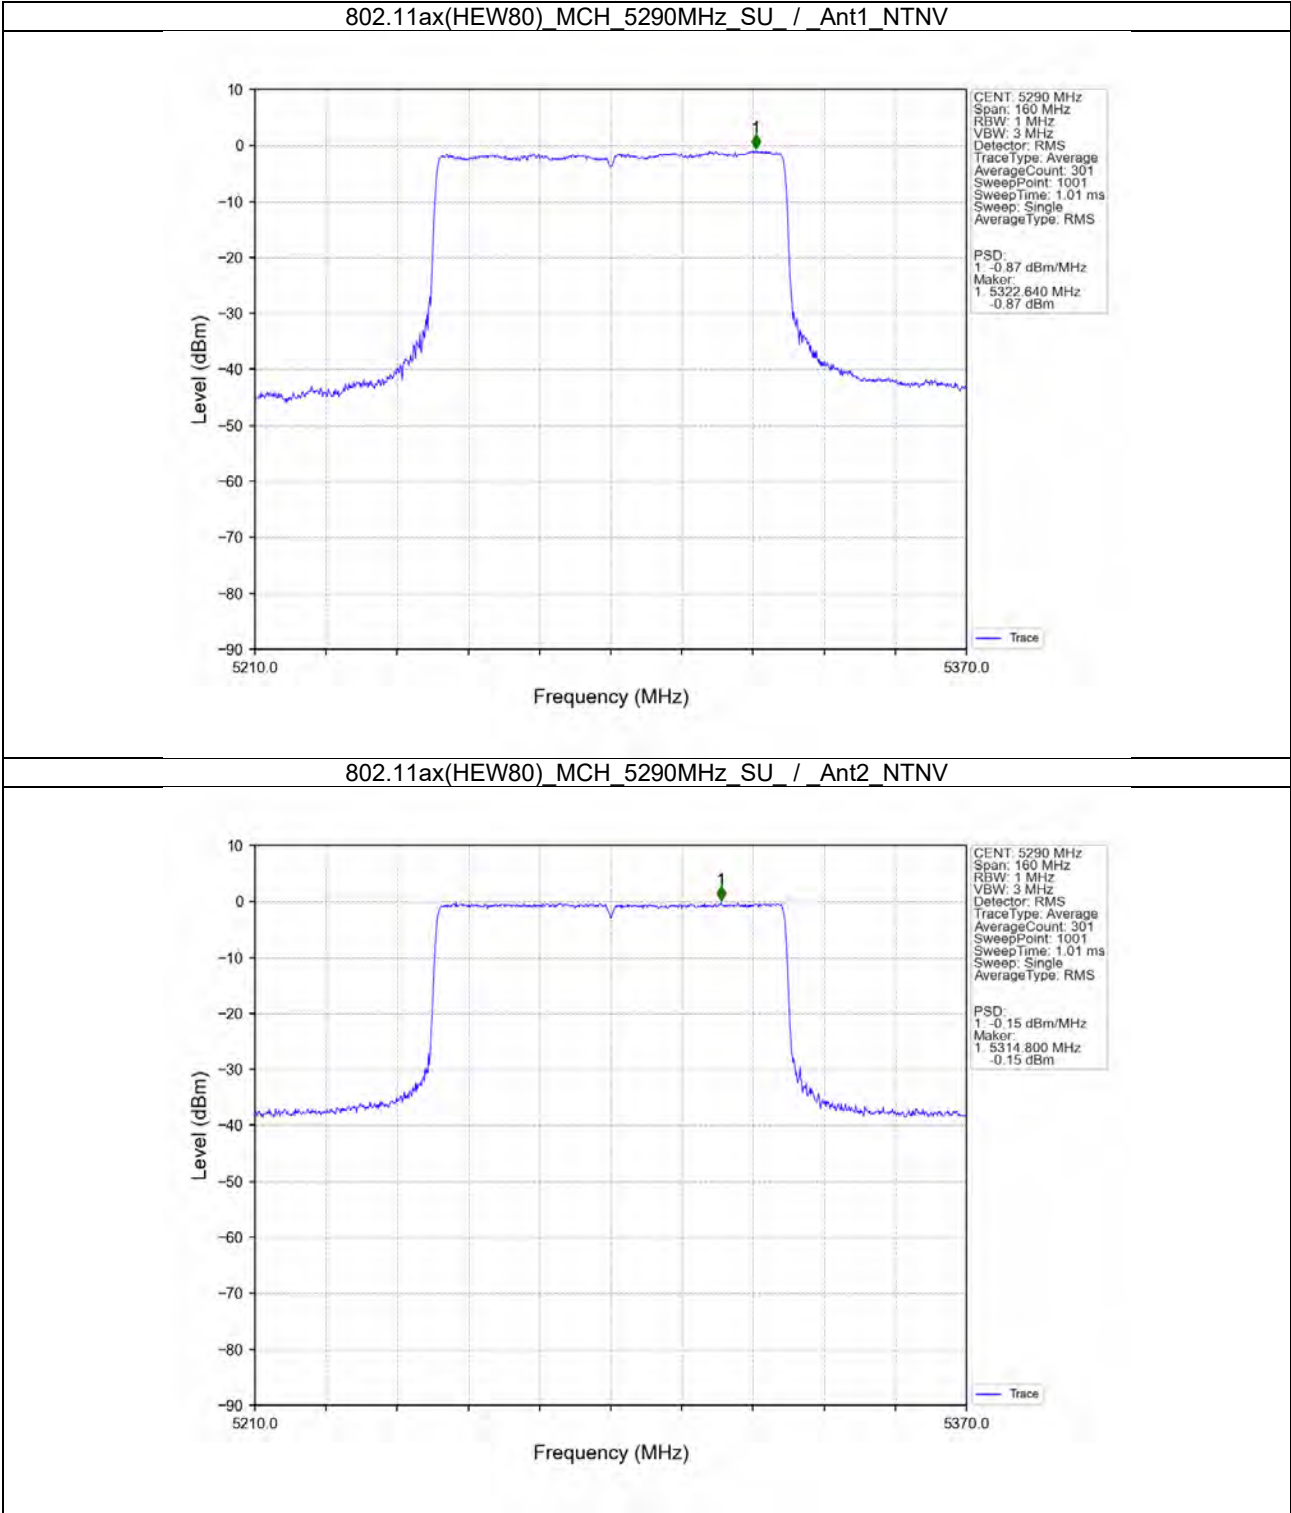



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 424 of 1085

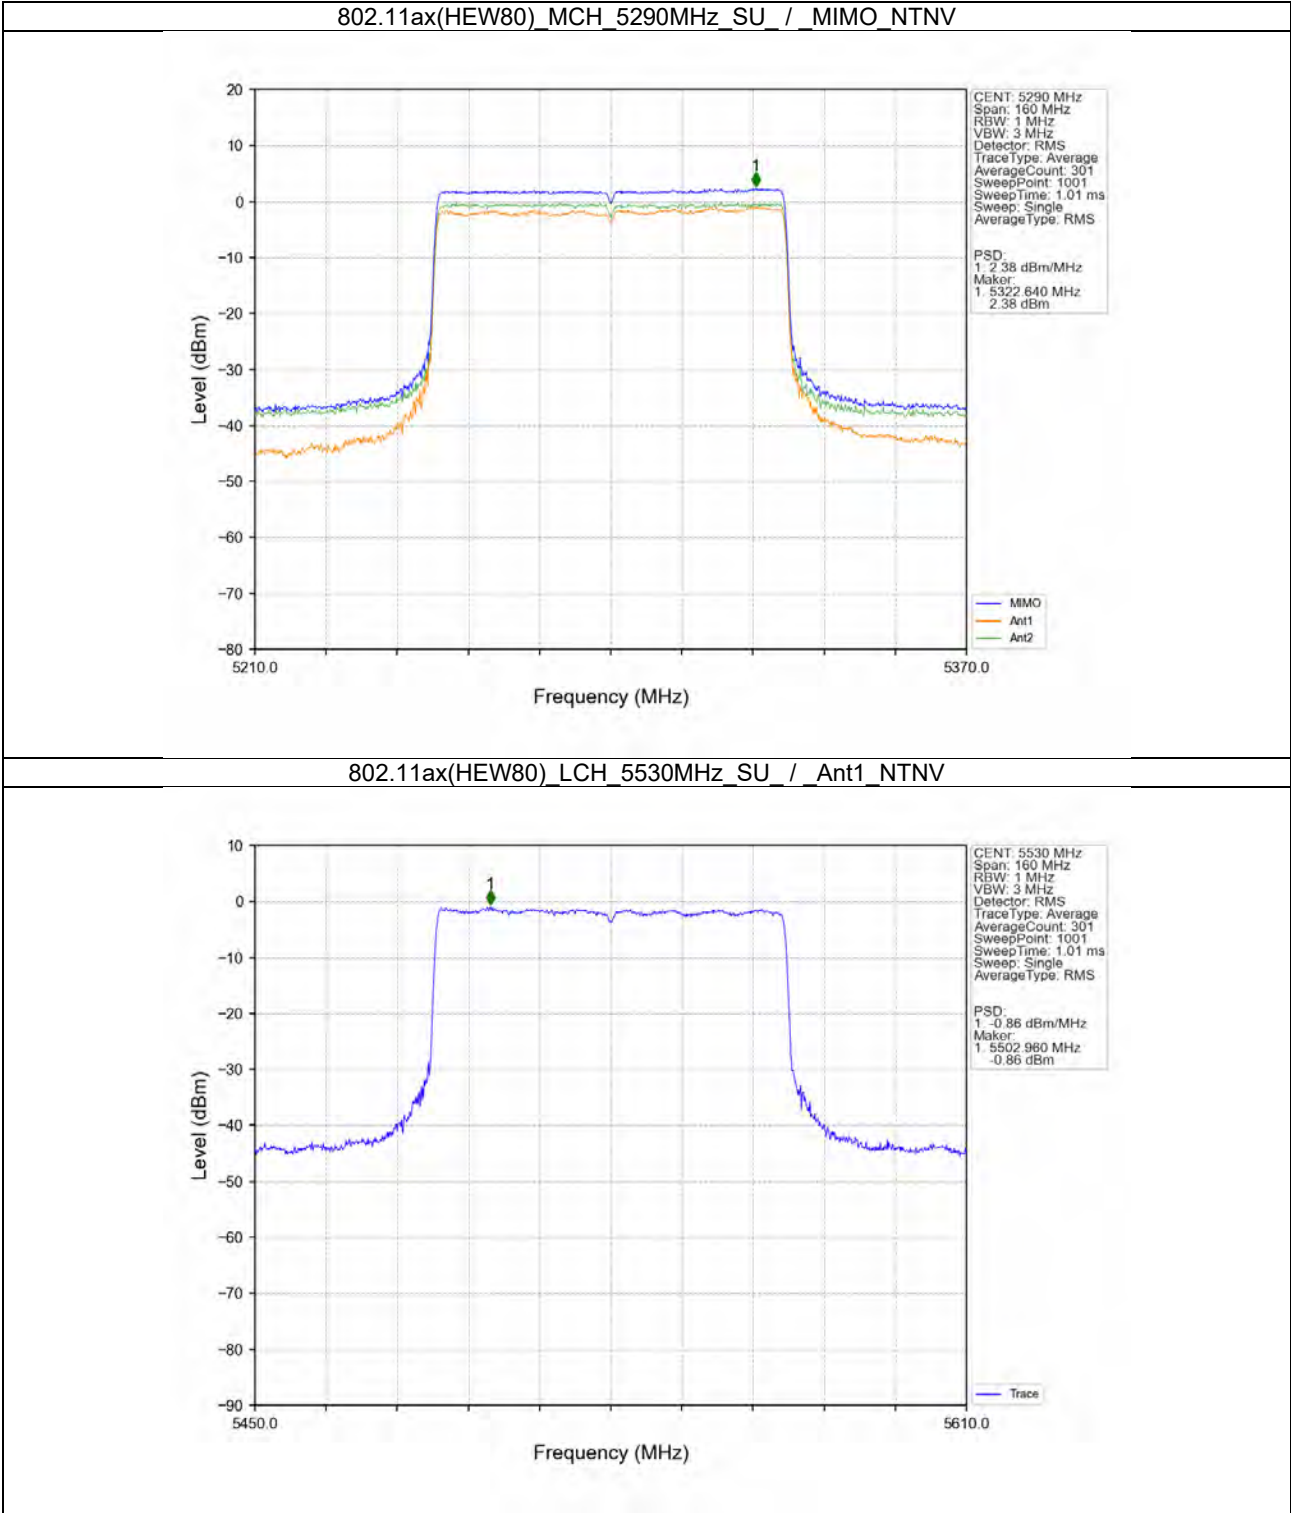



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 425 of 1085

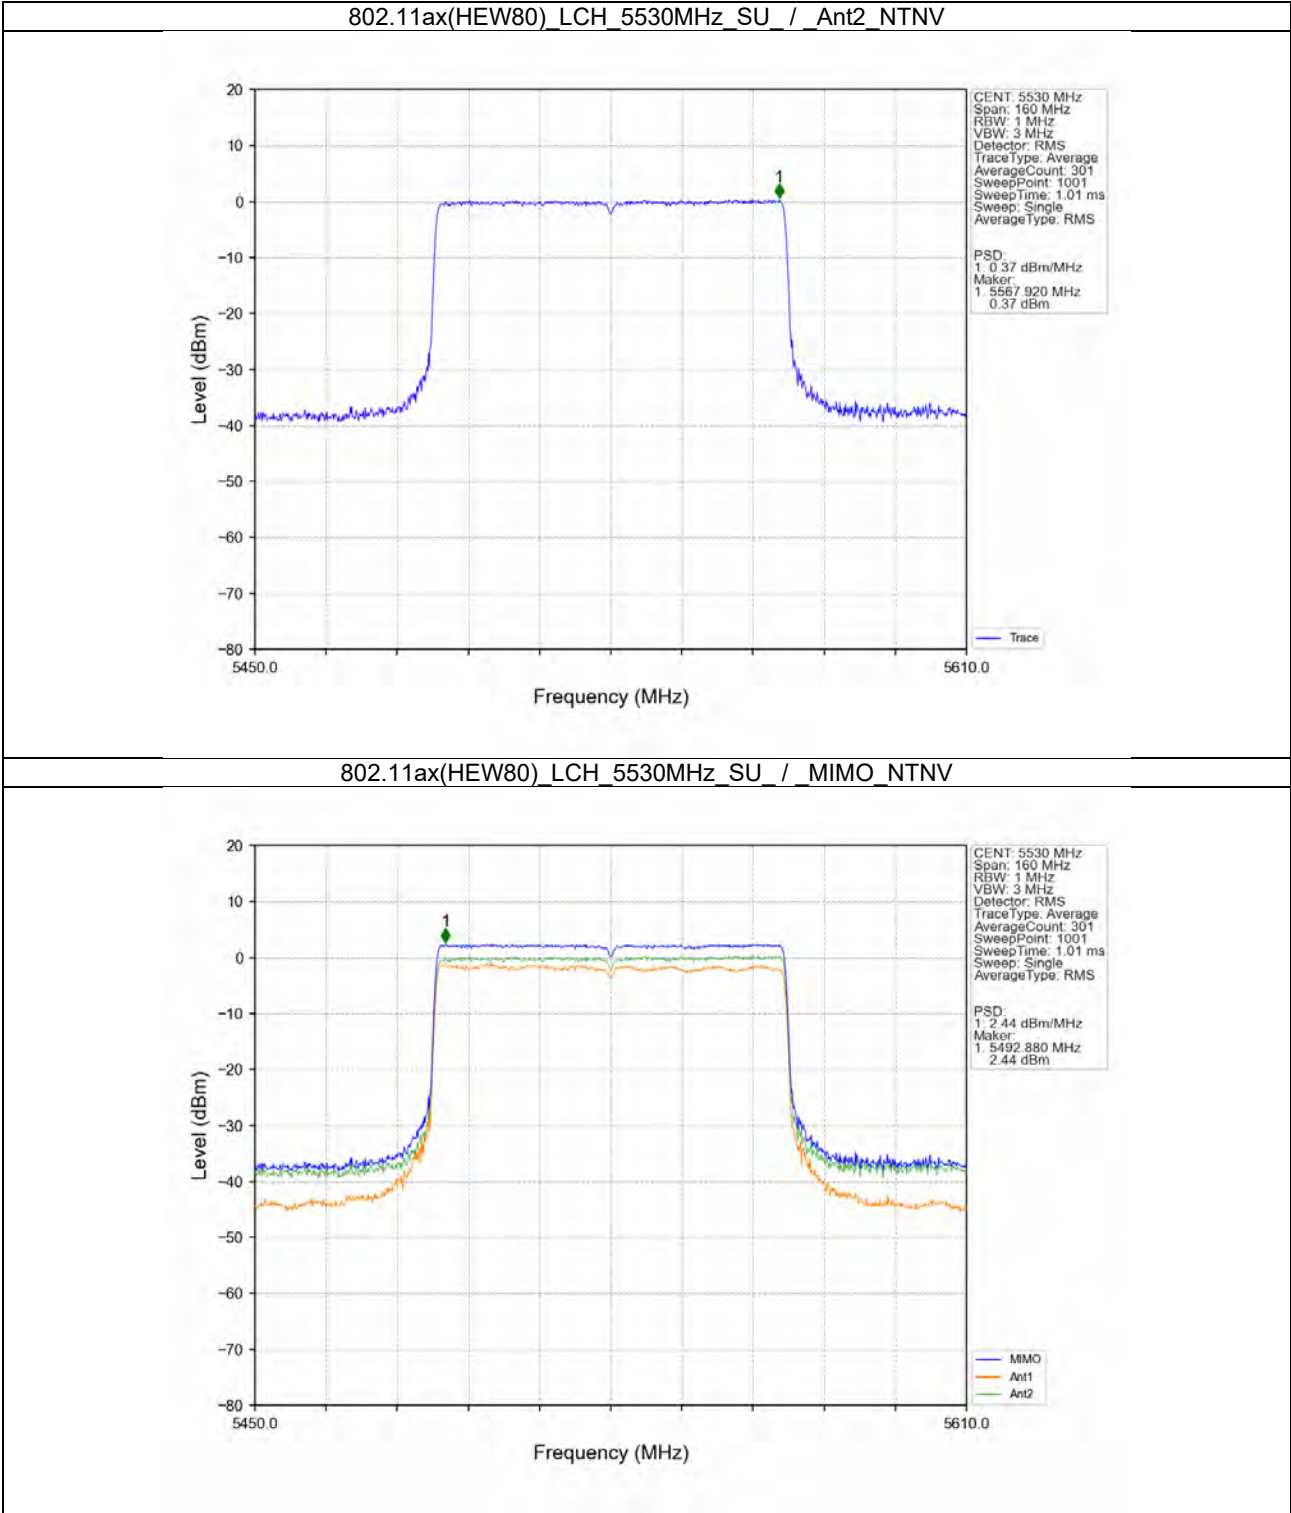



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 426 of 1085

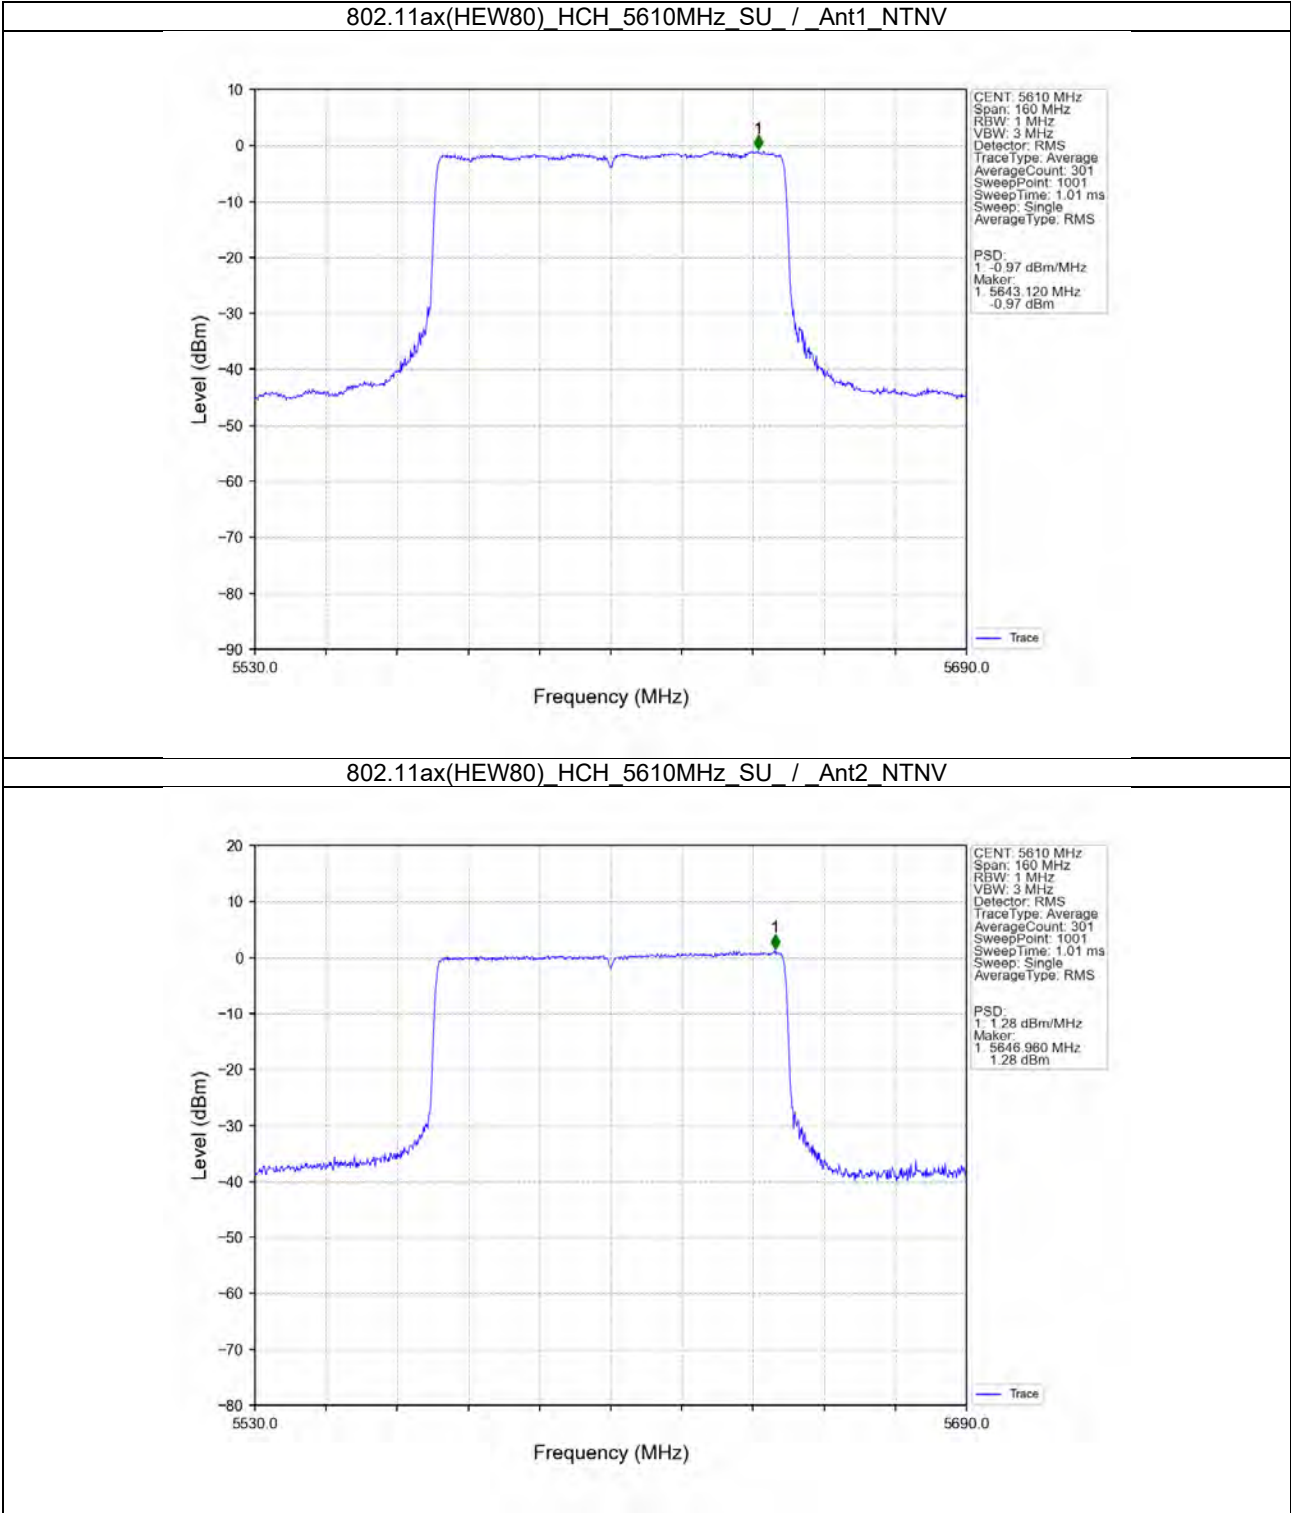



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 427 of 1085

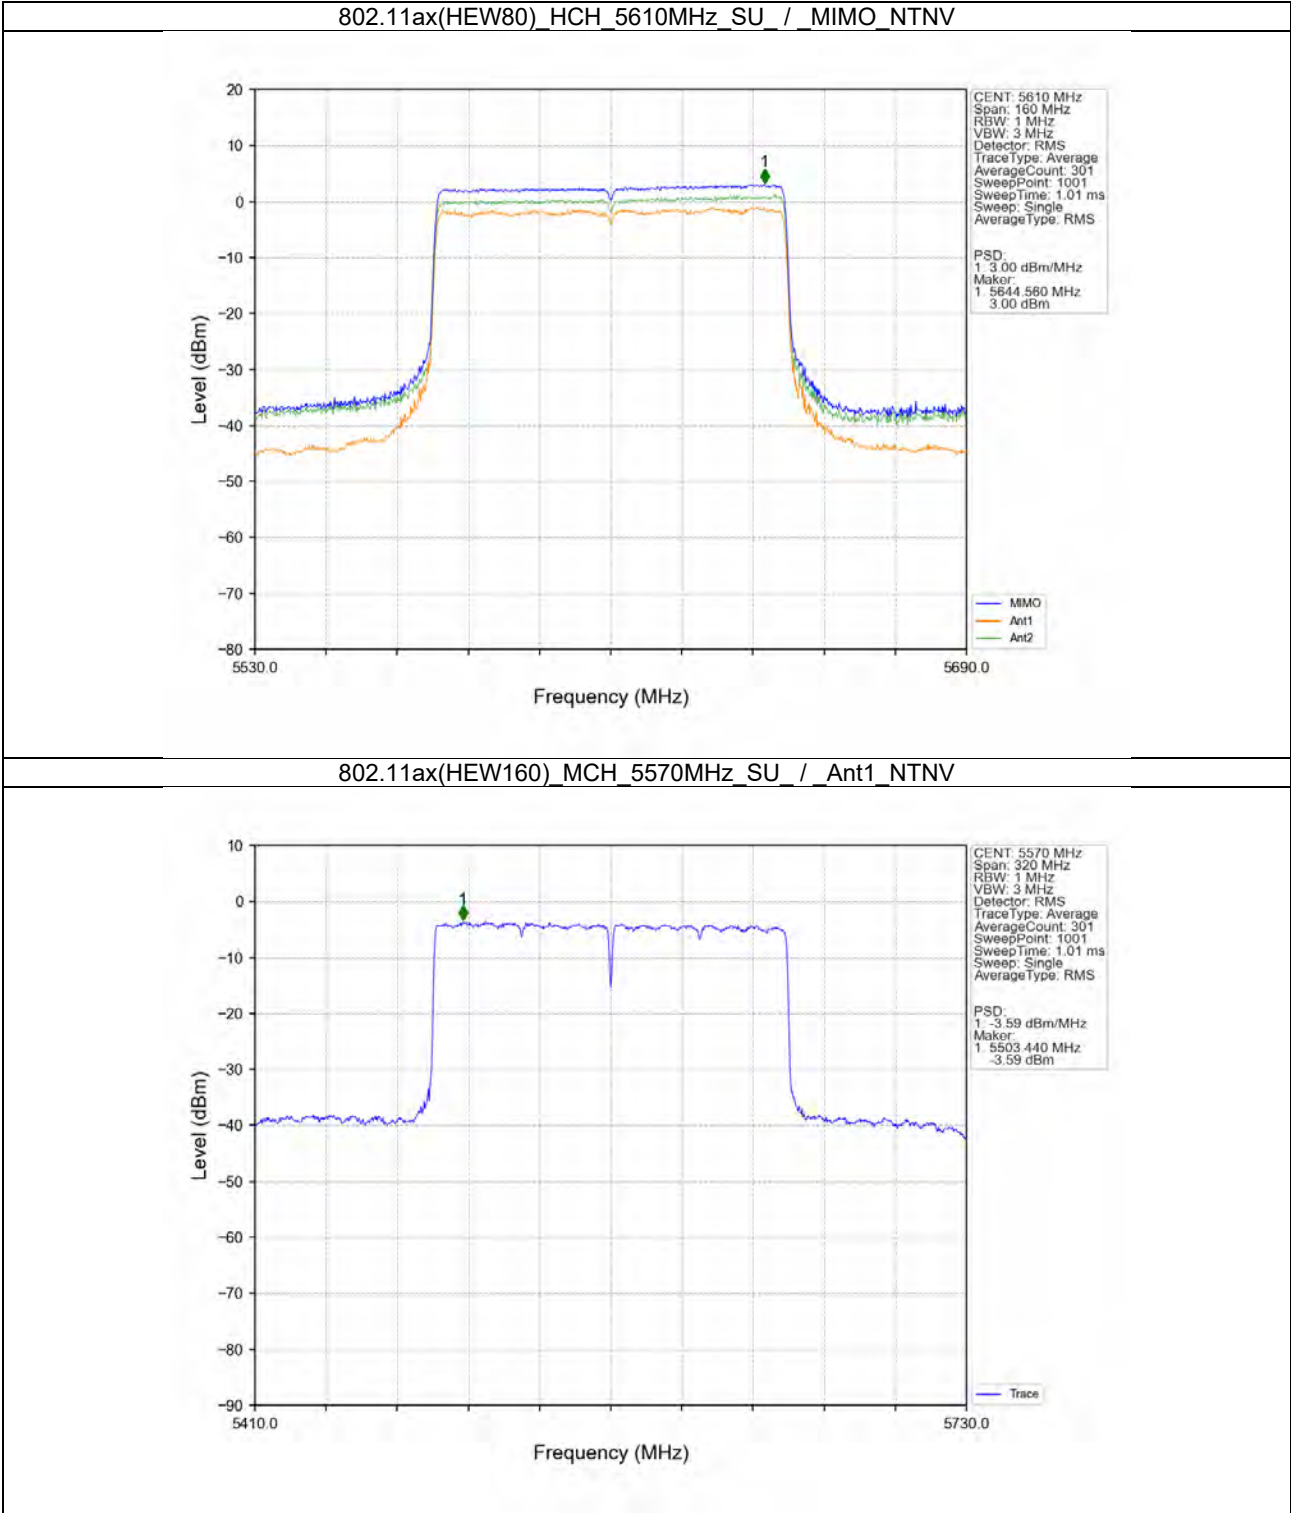



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 428 of 1085

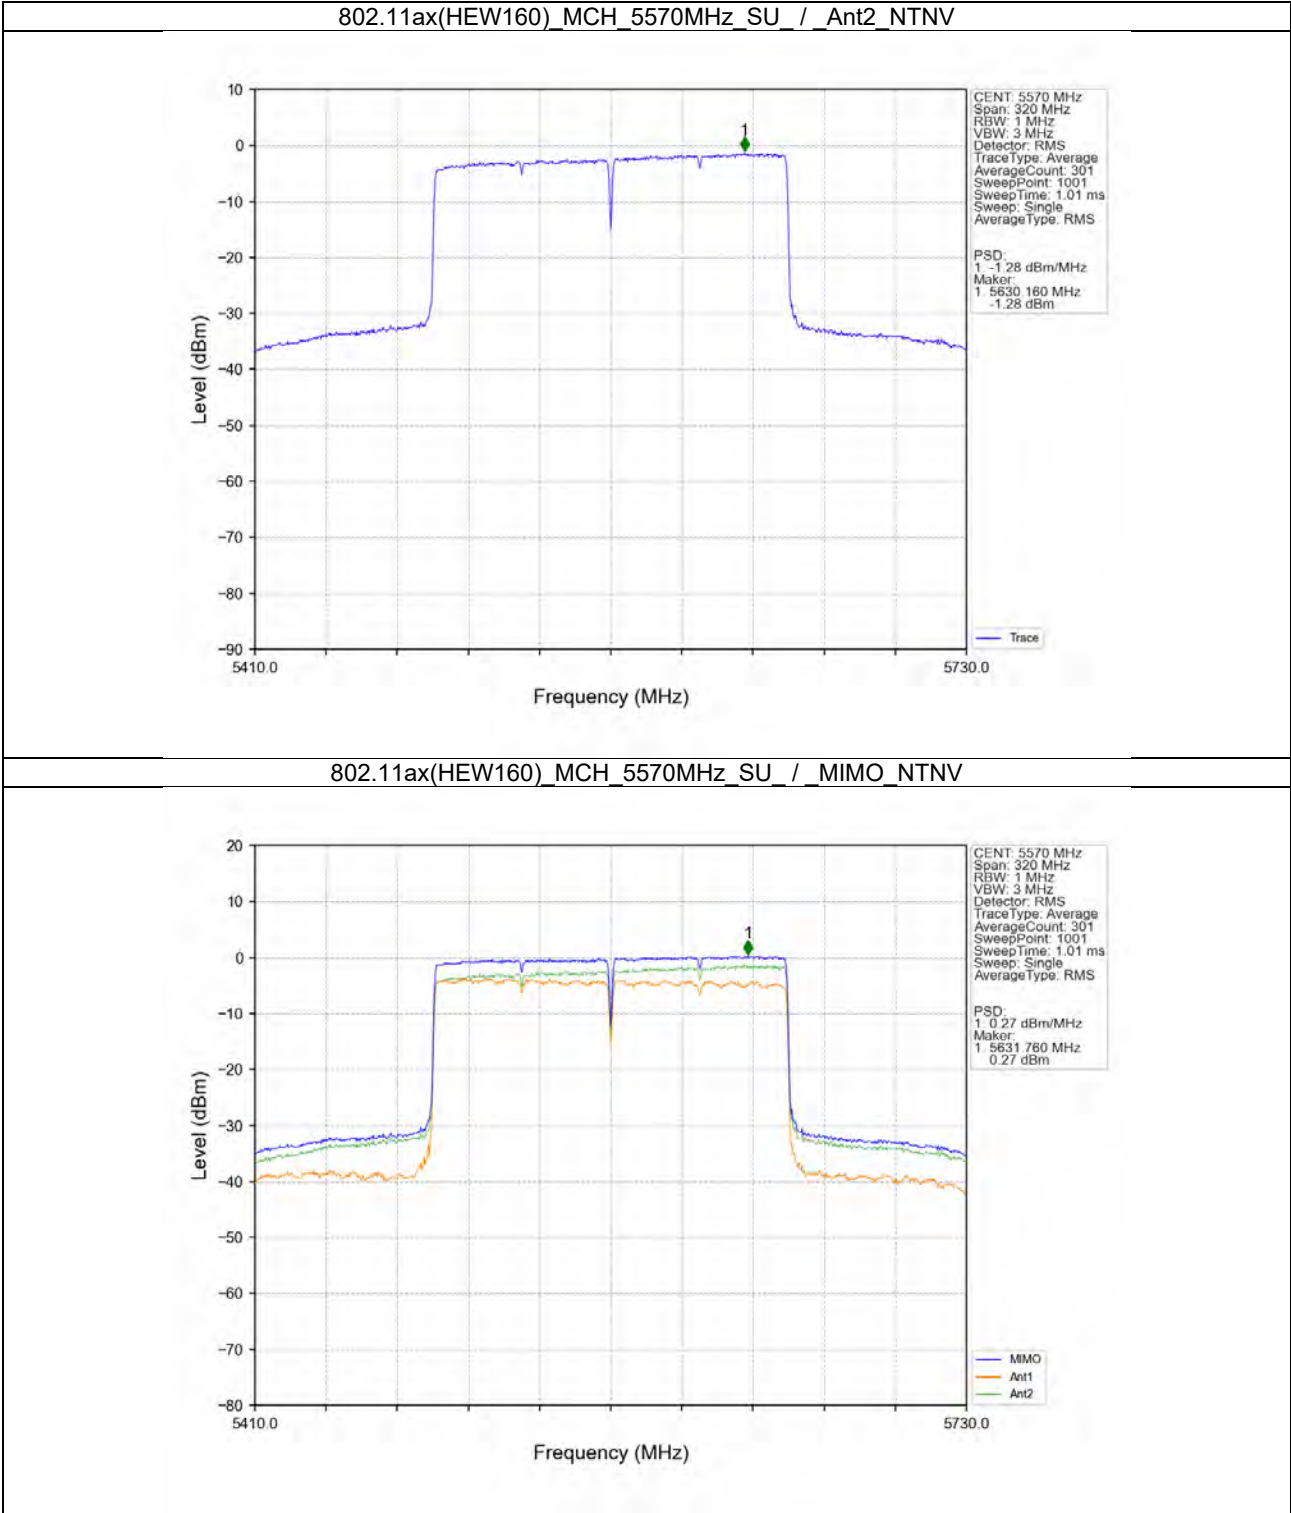



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 429 of 1085

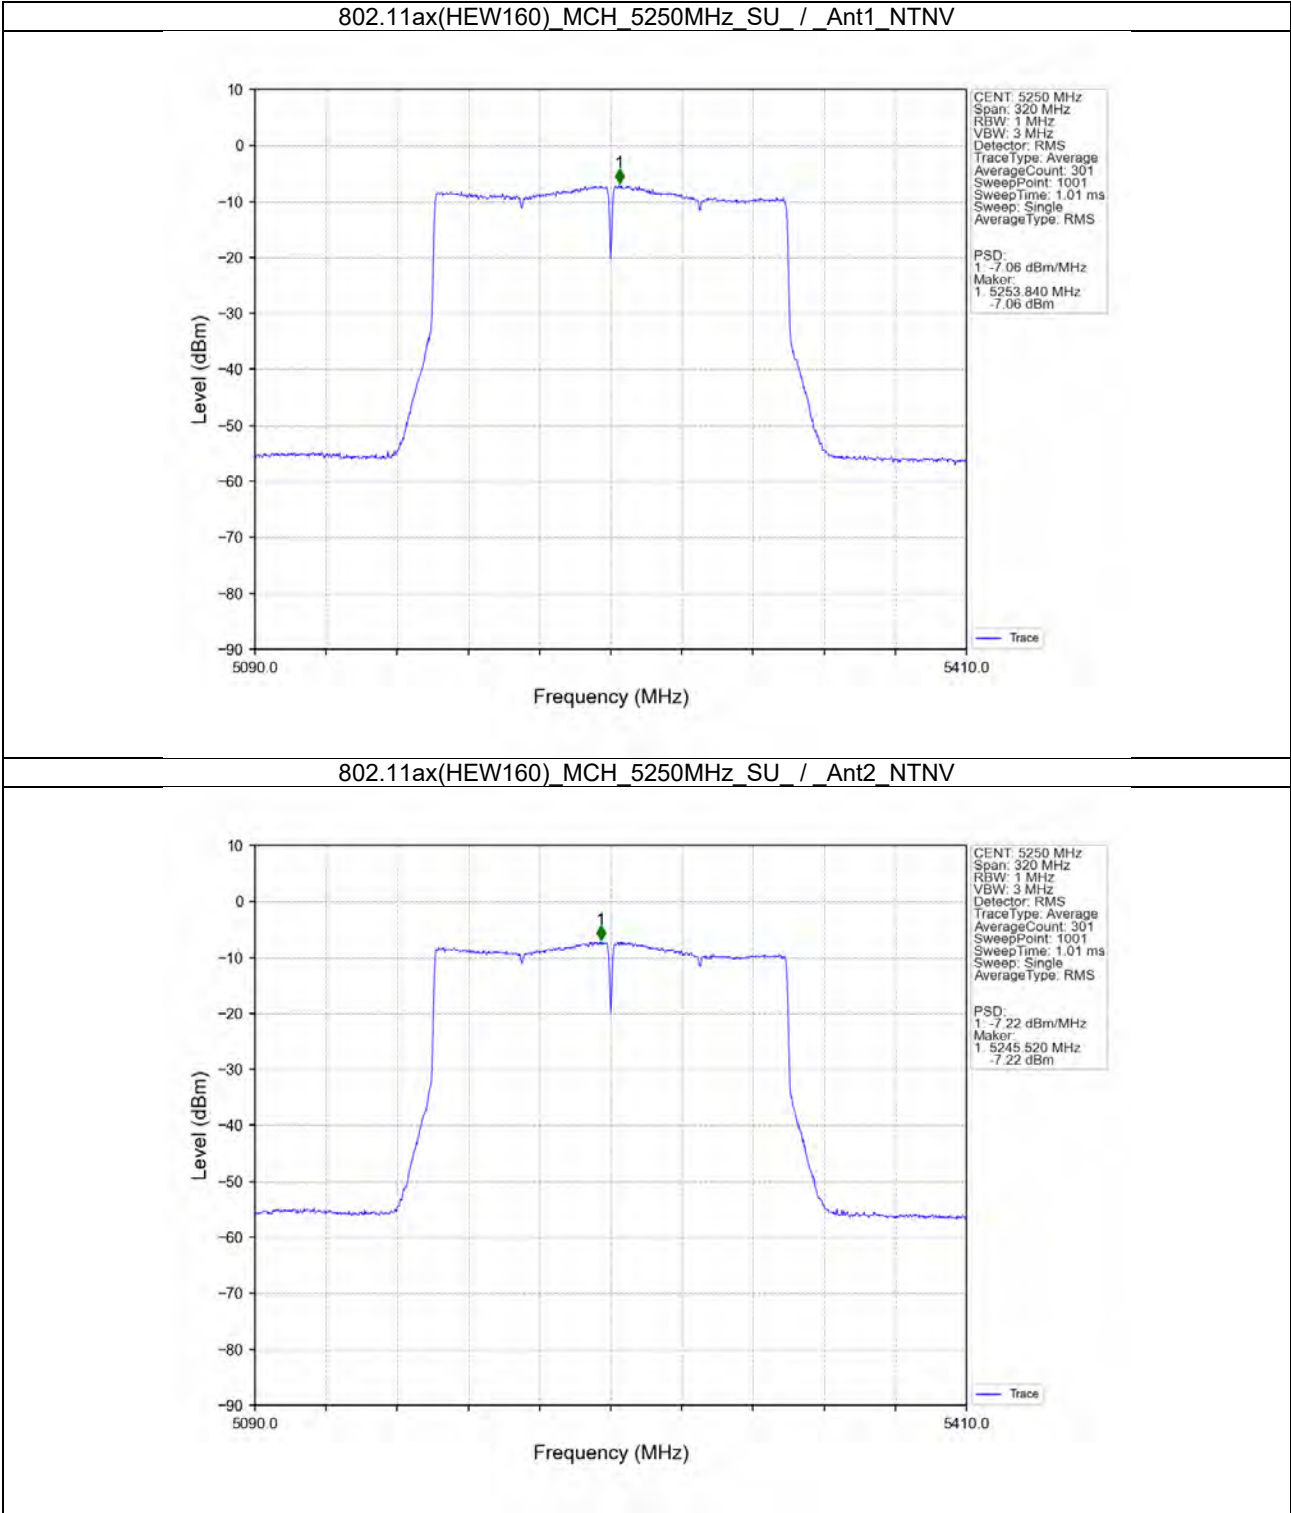



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.

Report No.: SUCR250300017004
Rev.: 01
Page: 430 of 1085

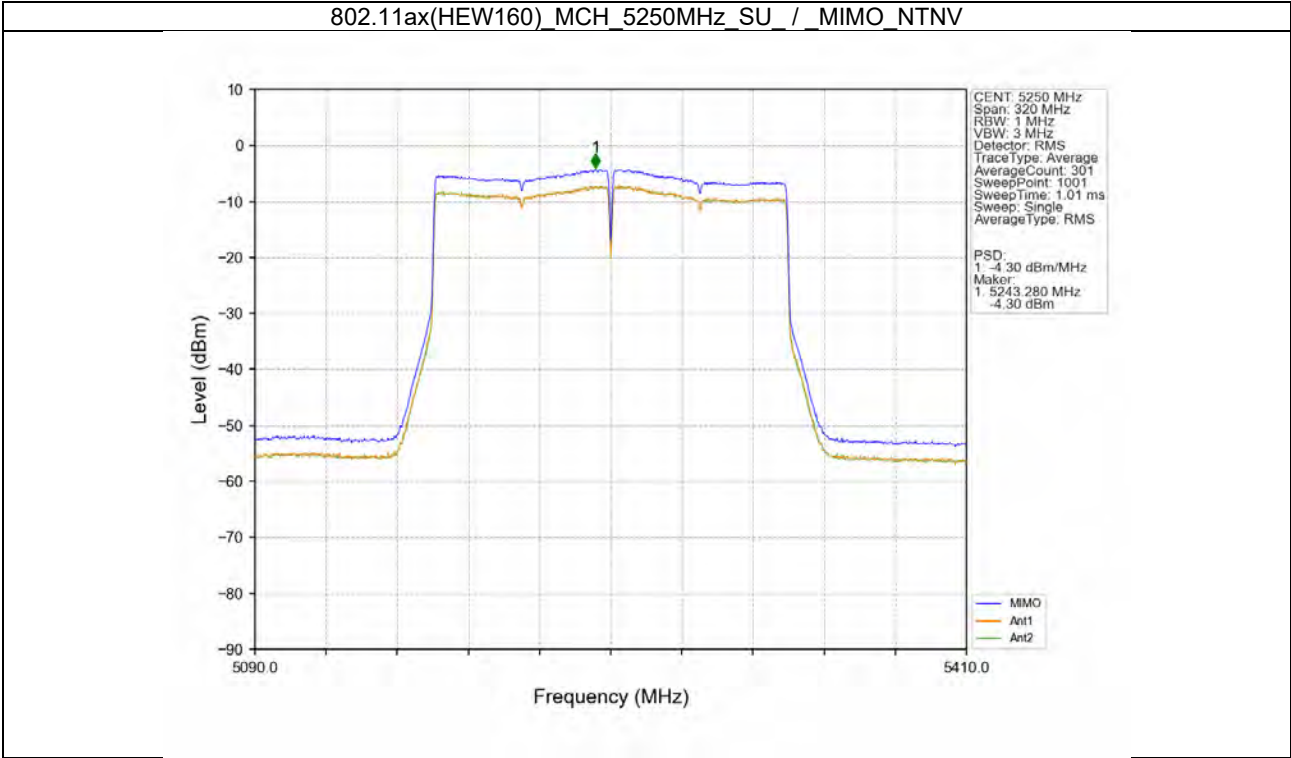




SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.

Report No.: SUCR250300017004
Rev.: 01
Page: 431 of 1085


4.2.2 PSD-Band3

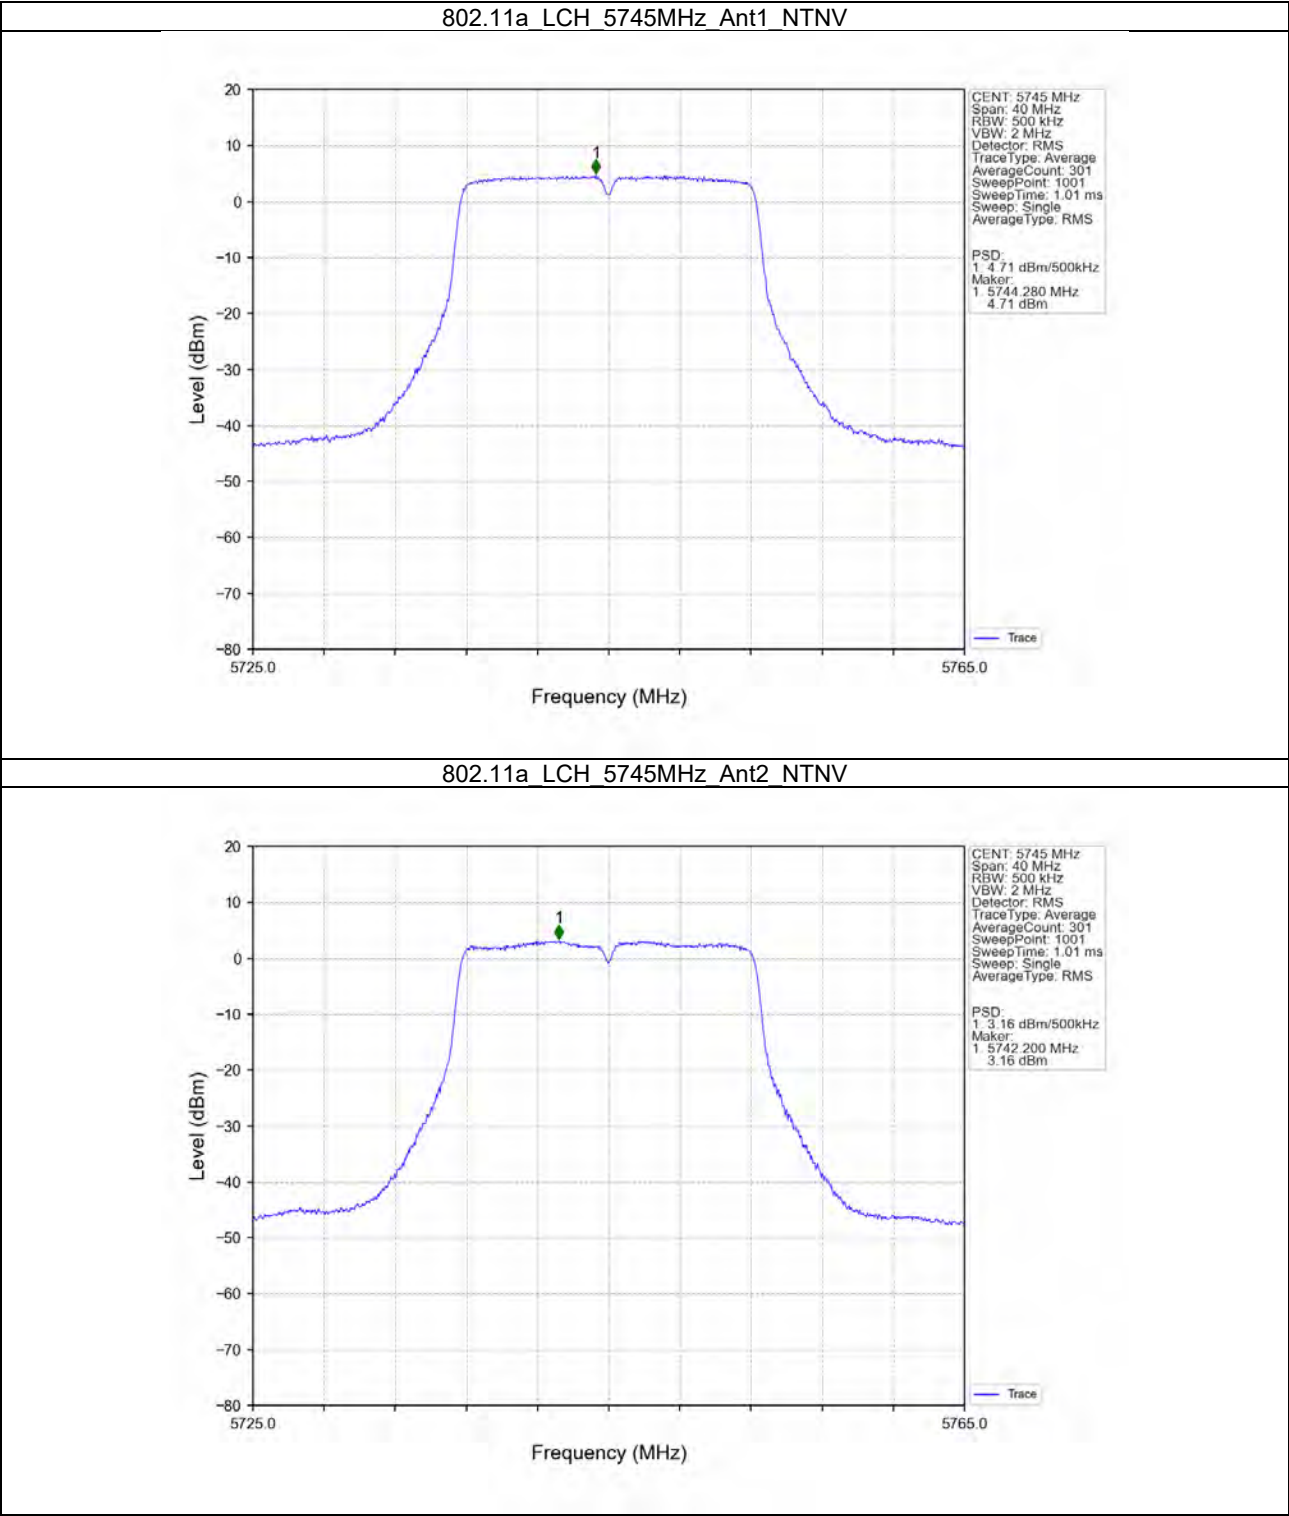



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 432 of 1085

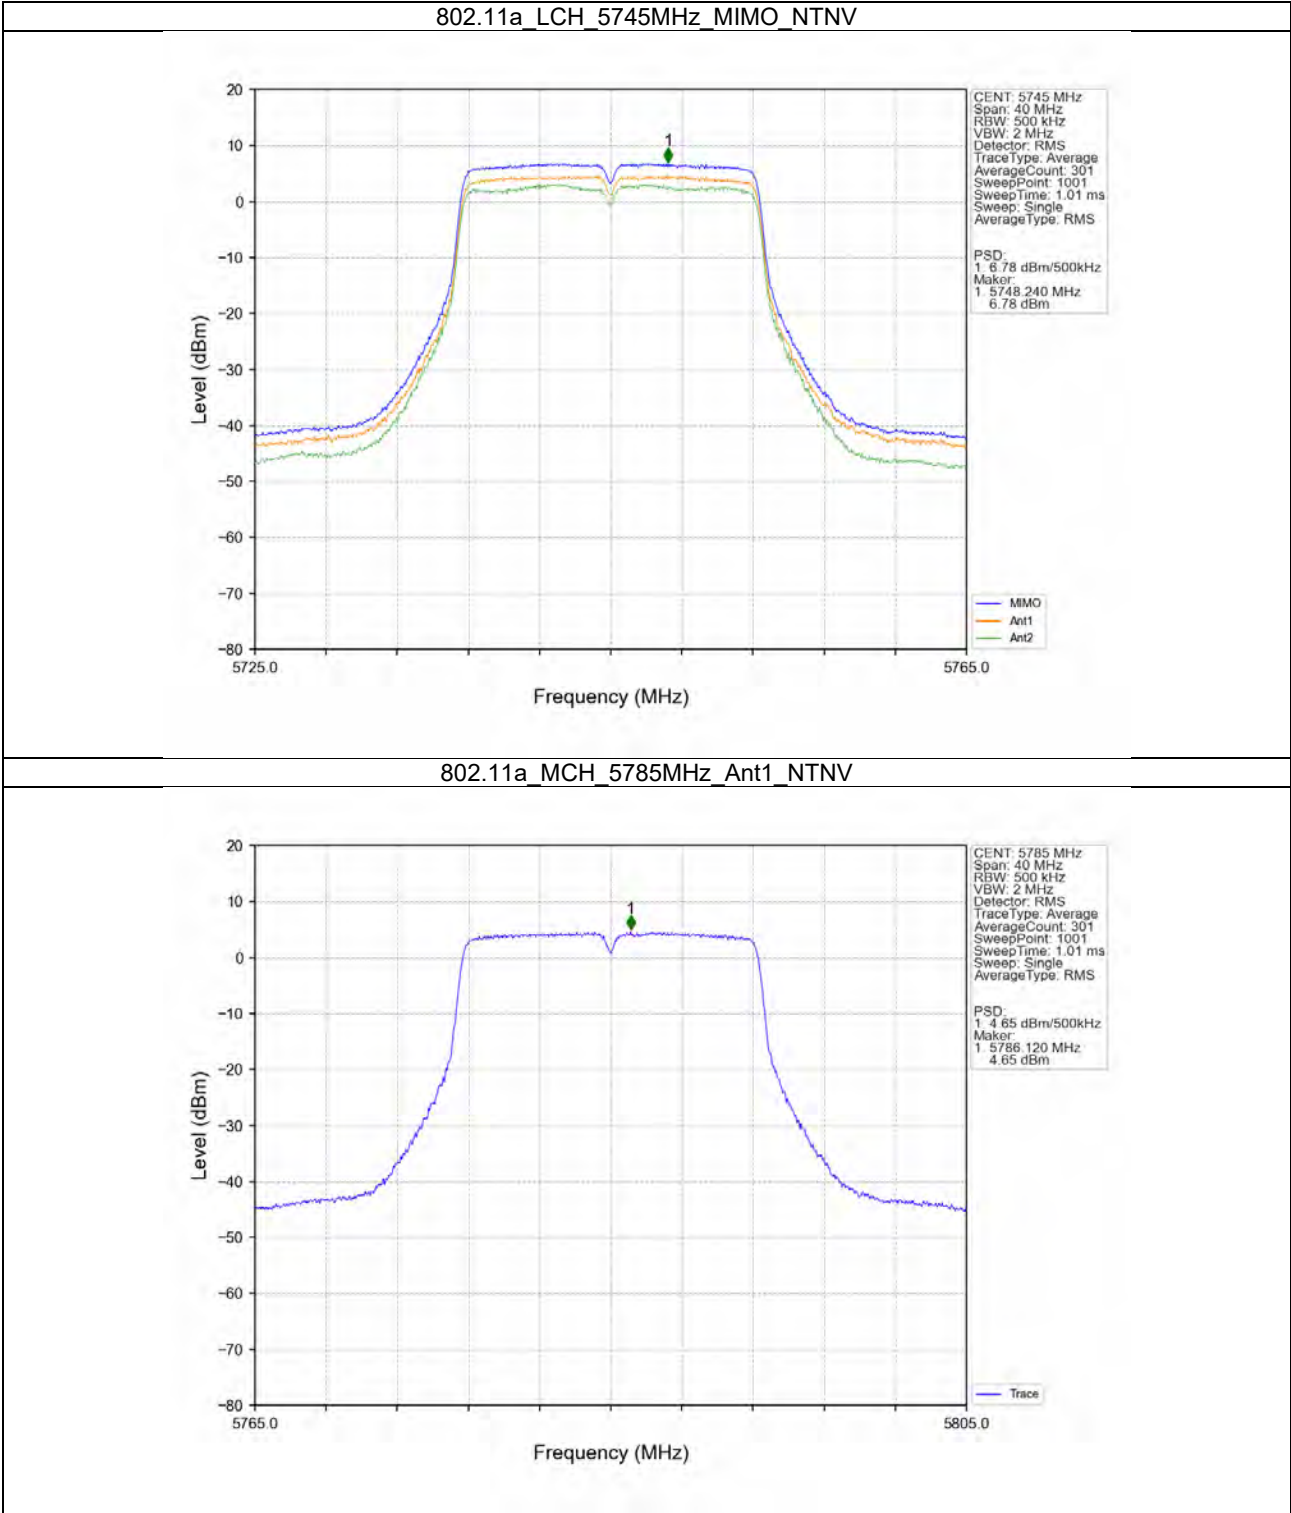



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.


Report No.: SUCR250300017004
Rev.: 01
Page: 433 of 1085

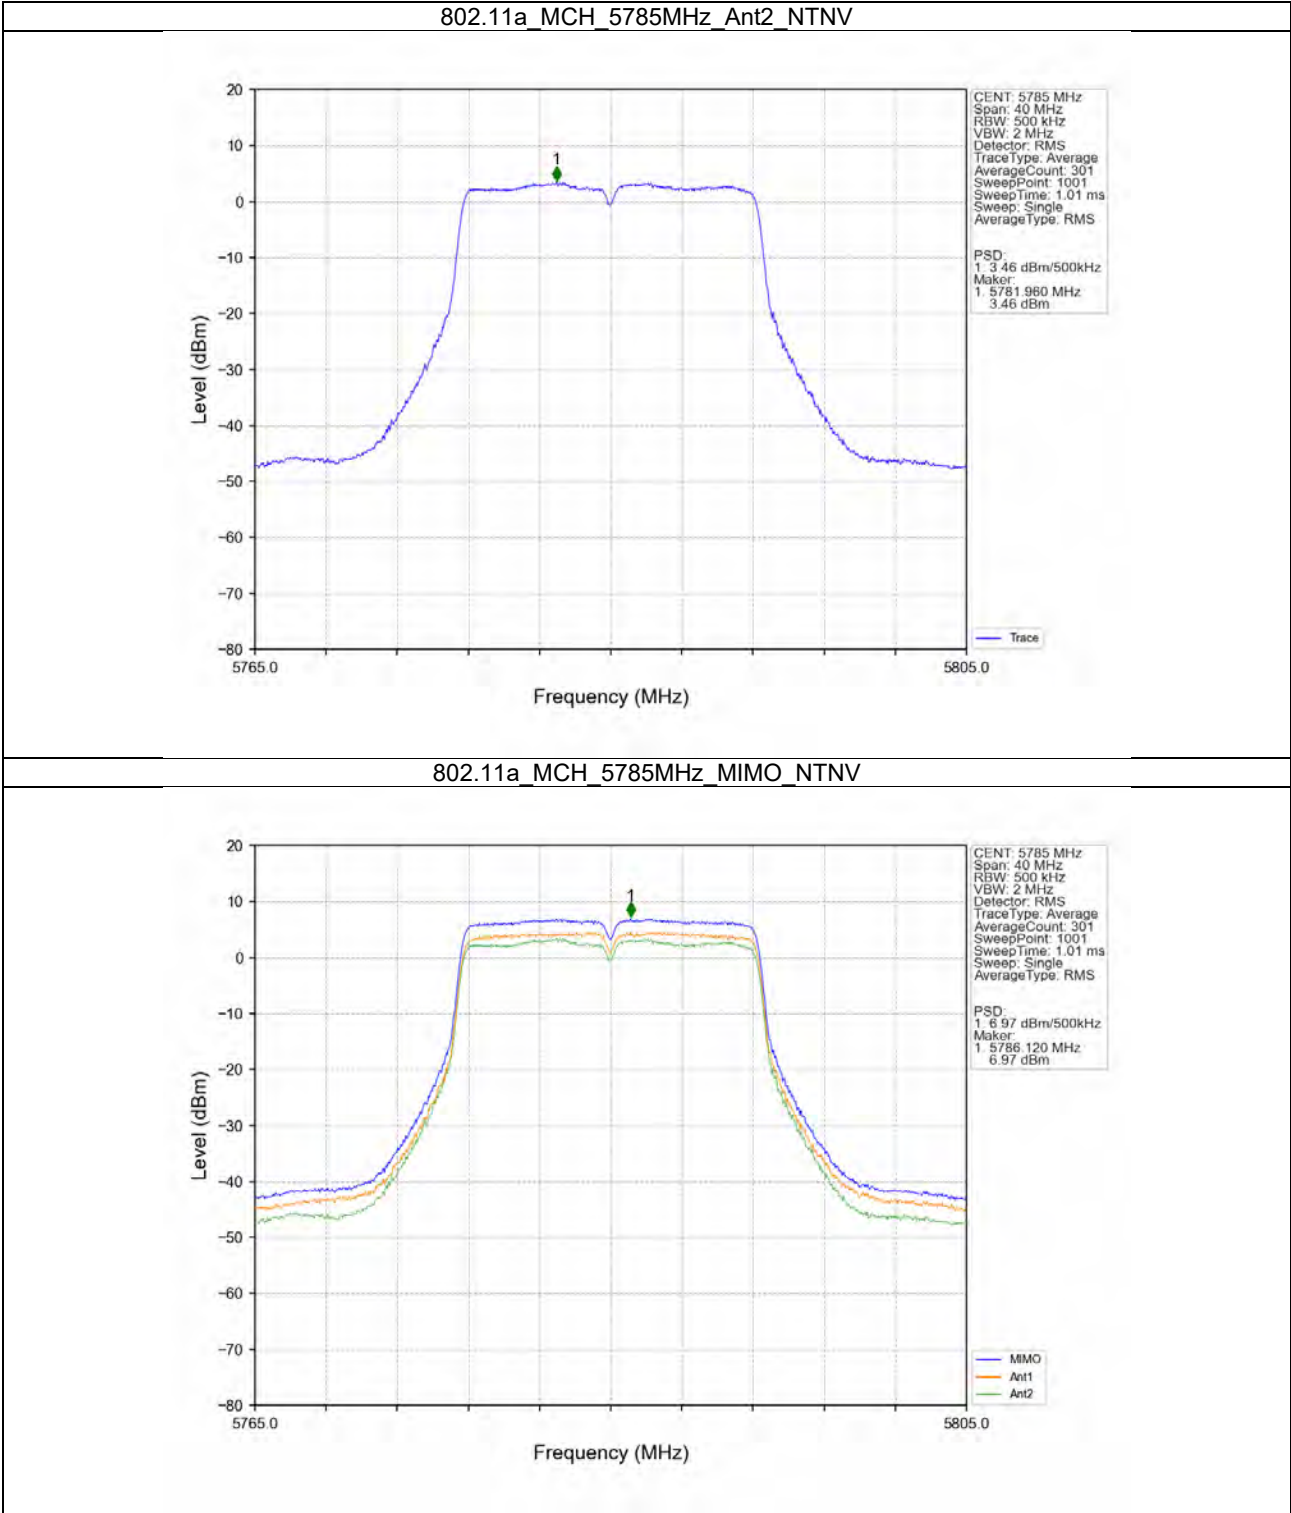



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.

Report No.: SUCR250300017004
Rev.: 01
Page: 434 of 1085

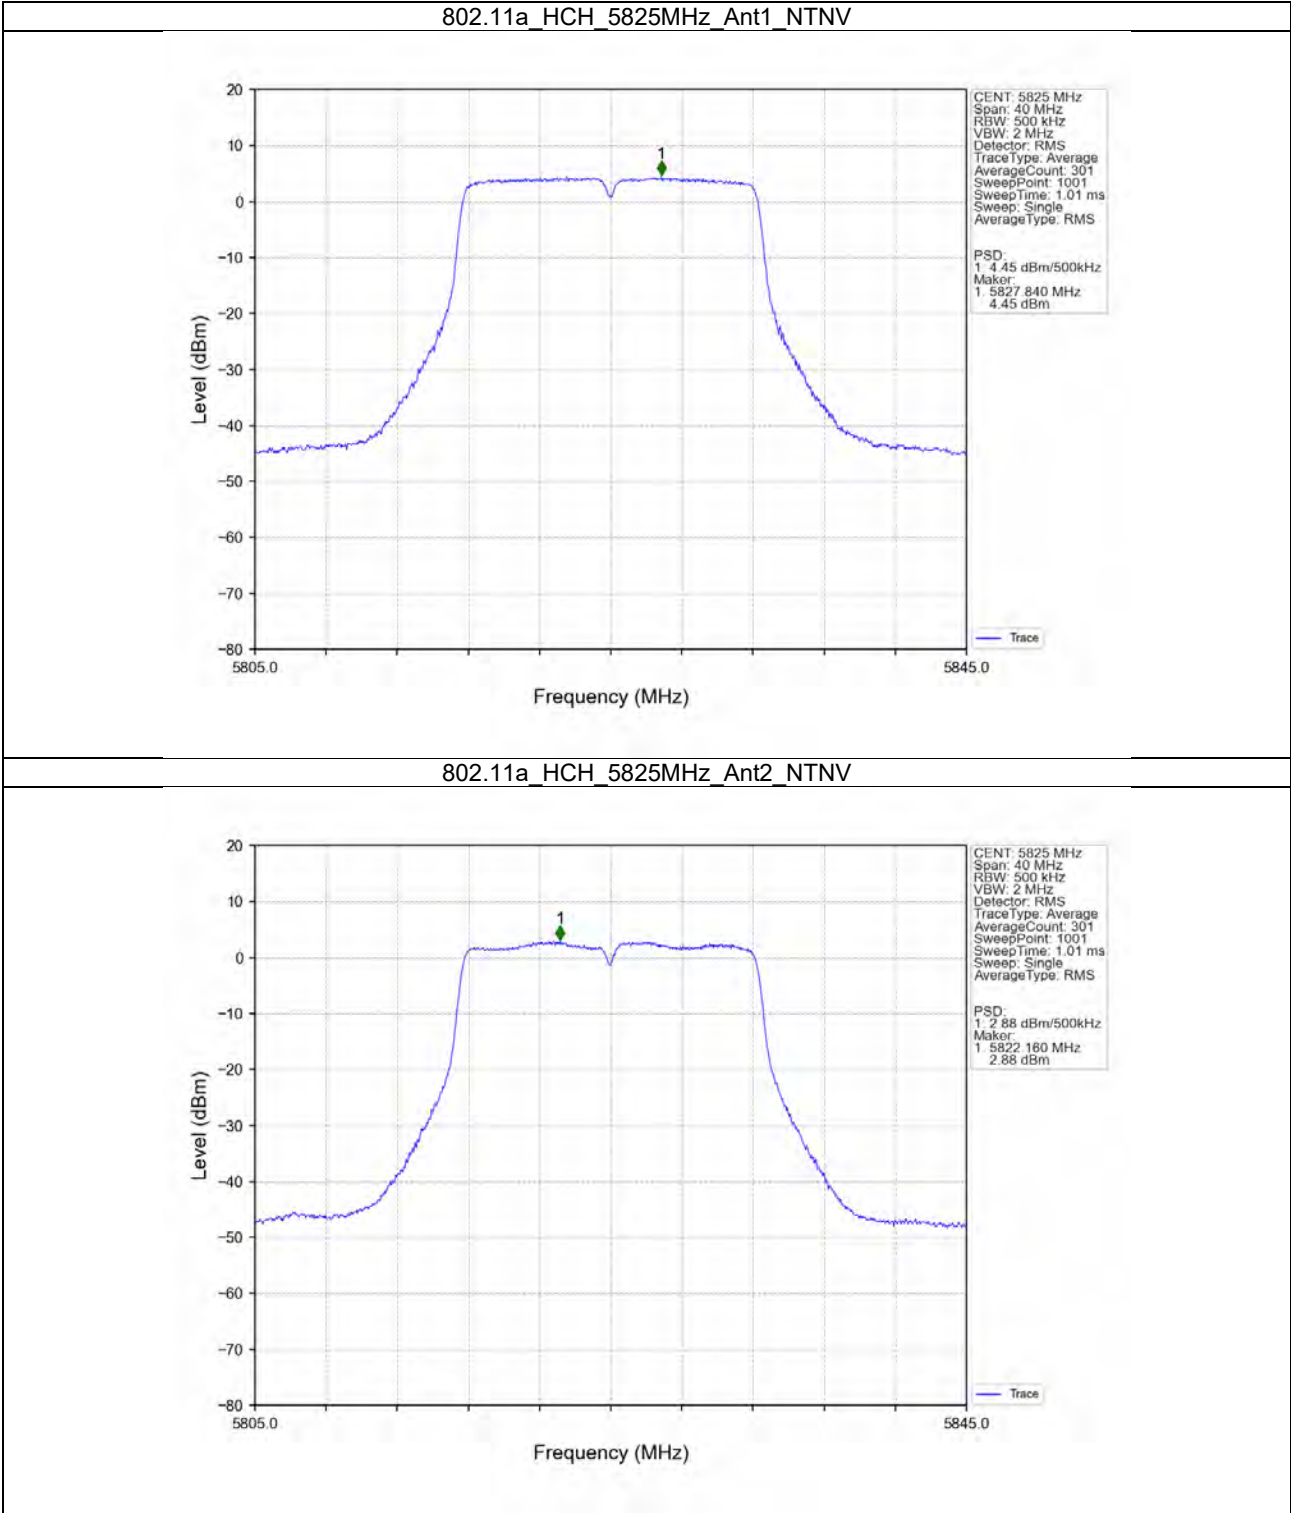



SGS-CSTC Standards Technical Services (Suzhou) Co., Ltd.

Report No.: SUCR250300017004
Rev.: 01
Page: 435 of 1085

