



## Appendix A3: Minimum 6dB Bandwidth

### Test Result B4

| Test Mode  | Antenna | Frequency[MHz] | 6db EBW [MHz] | FL[MHz]  | FH[MHz]  | Limit[MHz] | Verdict |
|------------|---------|----------------|---------------|----------|----------|------------|---------|
| 11A        | Ant1    | 5745           | 16.360        | 5736.840 | 5753.200 | 0.5        | PASS    |
| 11A        | Ant1    | 5785           | 16.400        | 5776.800 | 5793.200 | 0.5        | PASS    |
| 11A        | Ant1    | 5825           | 16.360        | 5816.840 | 5833.200 | 0.5        | PASS    |
| 11N20SISO  | Ant1    | 5745           | 17.600        | 5736.200 | 5753.800 | 0.5        | PASS    |
| 11N20SISO  | Ant1    | 5785           | 17.640        | 5776.200 | 5793.840 | 0.5        | PASS    |
| 11N20SISO  | Ant1    | 5825           | 17.600        | 5816.200 | 5833.800 | 0.5        | PASS    |
| 11N40SISO  | Ant1    | 5755           | 36.320        | 5736.840 | 5773.160 | 0.5        | PASS    |
| 11N40SISO  | Ant1    | 5795           | 36.320        | 5776.840 | 5813.160 | 0.5        | PASS    |
| 11AC20SISO | Ant1    | 5745           | 17.560        | 5736.240 | 5753.800 | 0.5        | PASS    |
| 11AC20SISO | Ant1    | 5785           | 17.560        | 5776.240 | 5793.800 | 0.5        | PASS    |
| 11AC20SISO | Ant1    | 5825           | 17.560        | 5816.240 | 5833.800 | 0.5        | PASS    |
| 11AC40SISO | Ant1    | 5755           | 36.320        | 5736.840 | 5773.160 | 0.5        | PASS    |
| 11AC40SISO | Ant1    | 5795           | 36.320        | 5776.840 | 5813.160 | 0.5        | PASS    |
| 11AX20SISO | Ant1    | 5745           | 19.000        | 5735.520 | 5754.520 | 0.5        | PASS    |
| 11AX20SISO | Ant1    | 5785           | 18.880        | 5775.560 | 5794.440 | 0.5        | PASS    |
| 11AX20SISO | Ant1    | 5825           | 18.960        | 5815.560 | 5834.520 | 0.5        | PASS    |
| 11AX40SISO | Ant1    | 5755           | 37.920        | 5736.120 | 5774.040 | 0.5        | PASS    |
| 11AX40SISO | Ant1    | 5795           | 38.000        | 5776.040 | 5814.040 | 0.5        | PASS    |

## Test Graphs B4

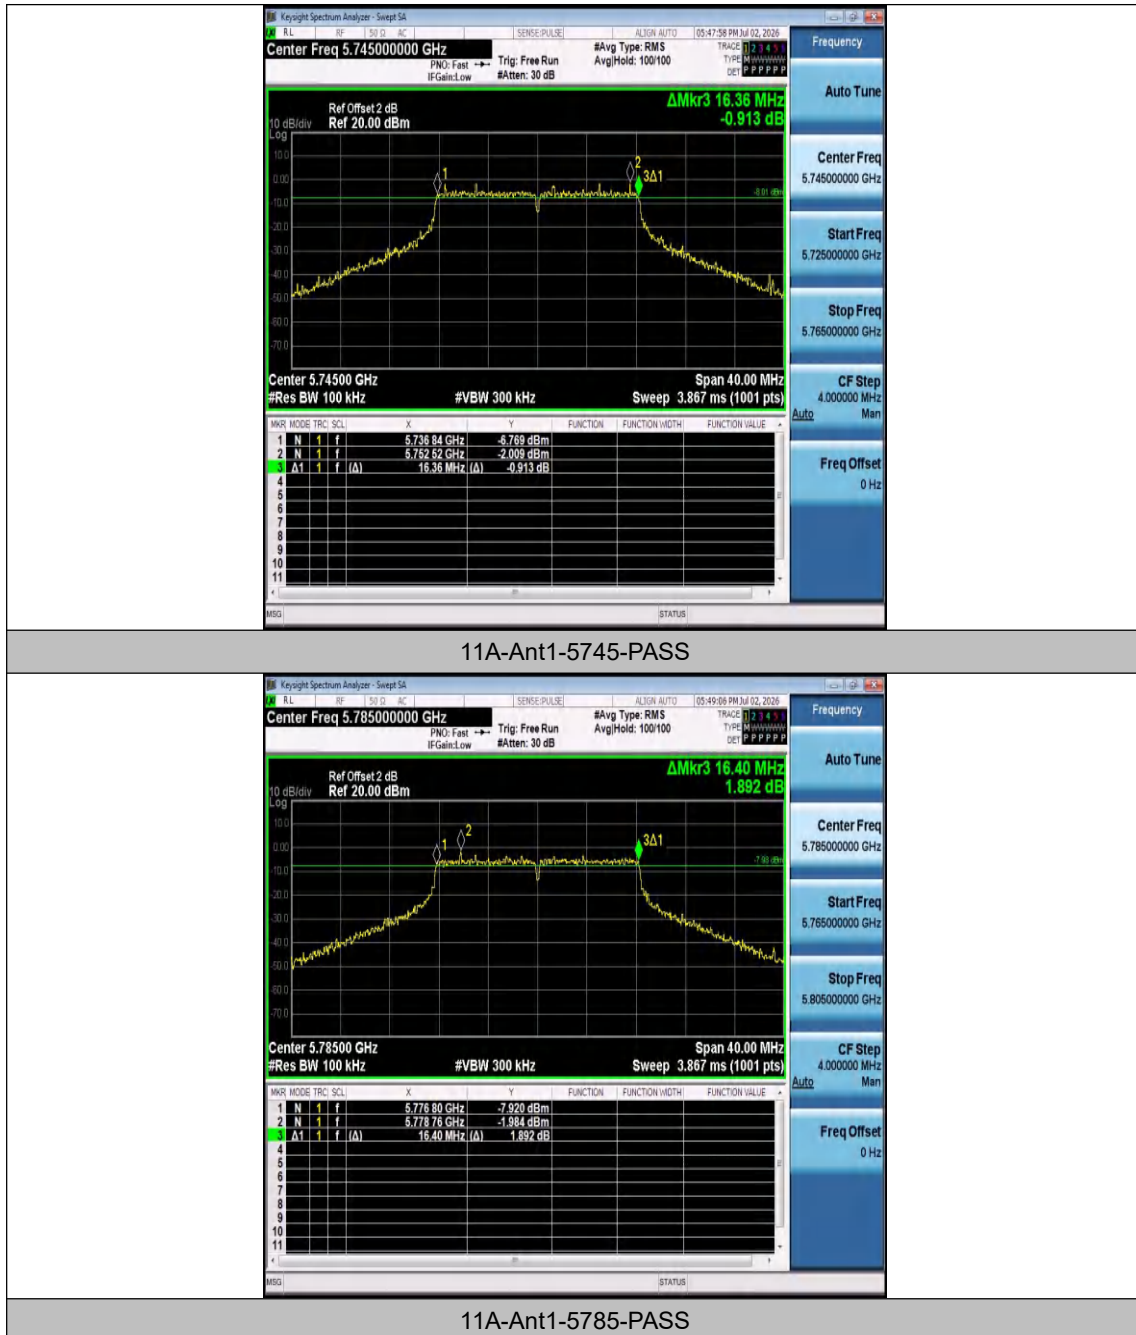


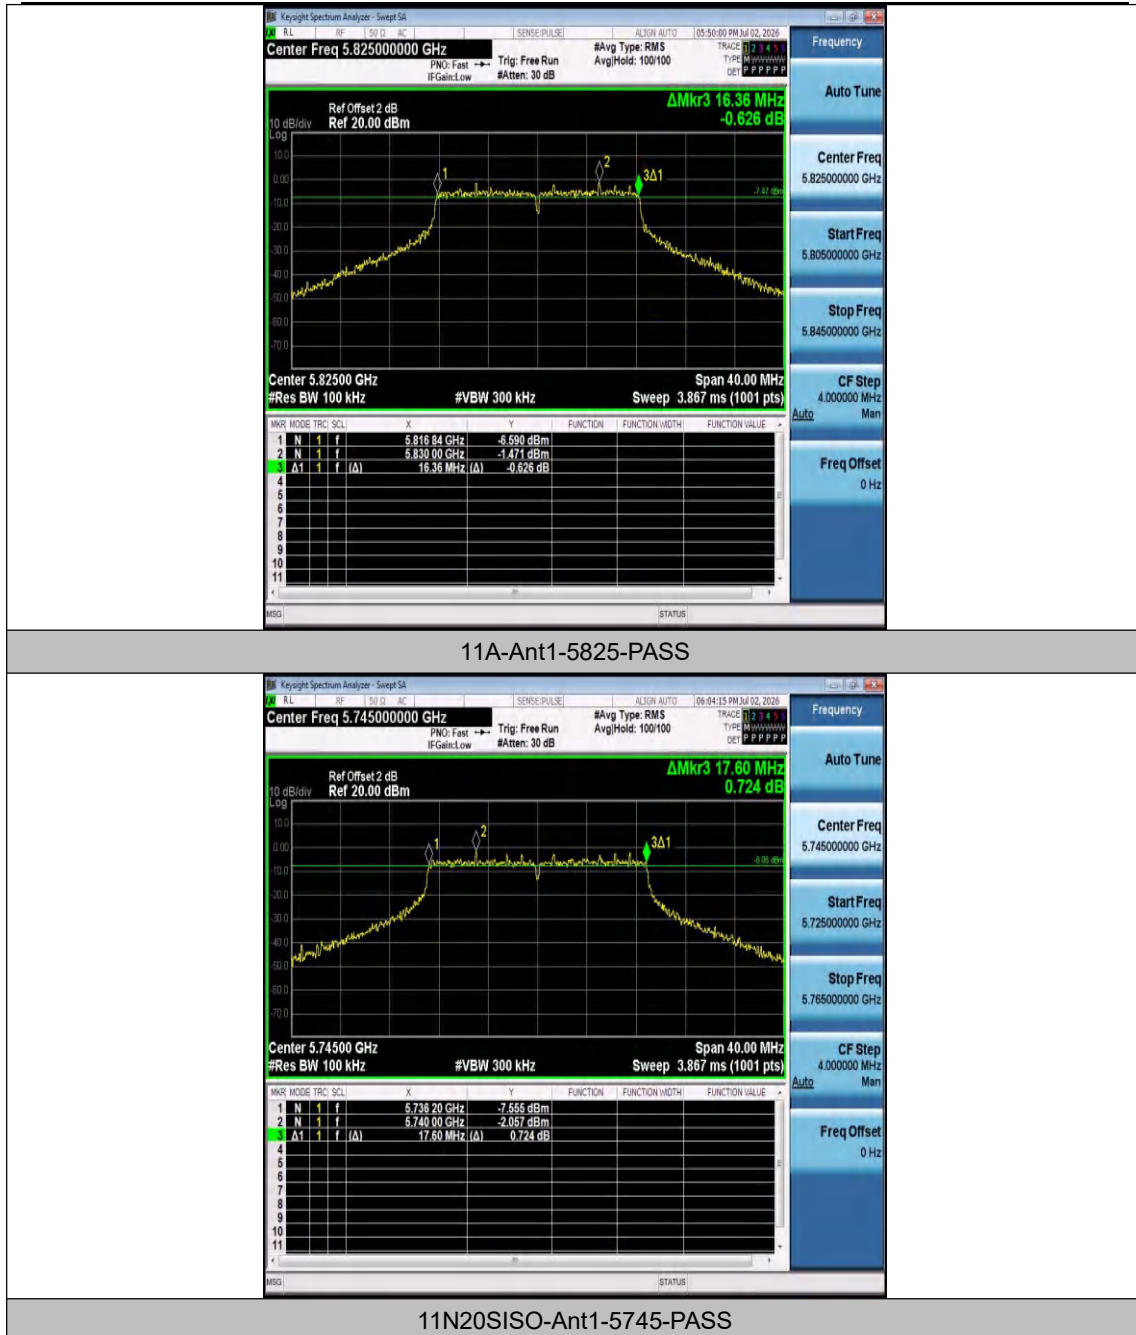


### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

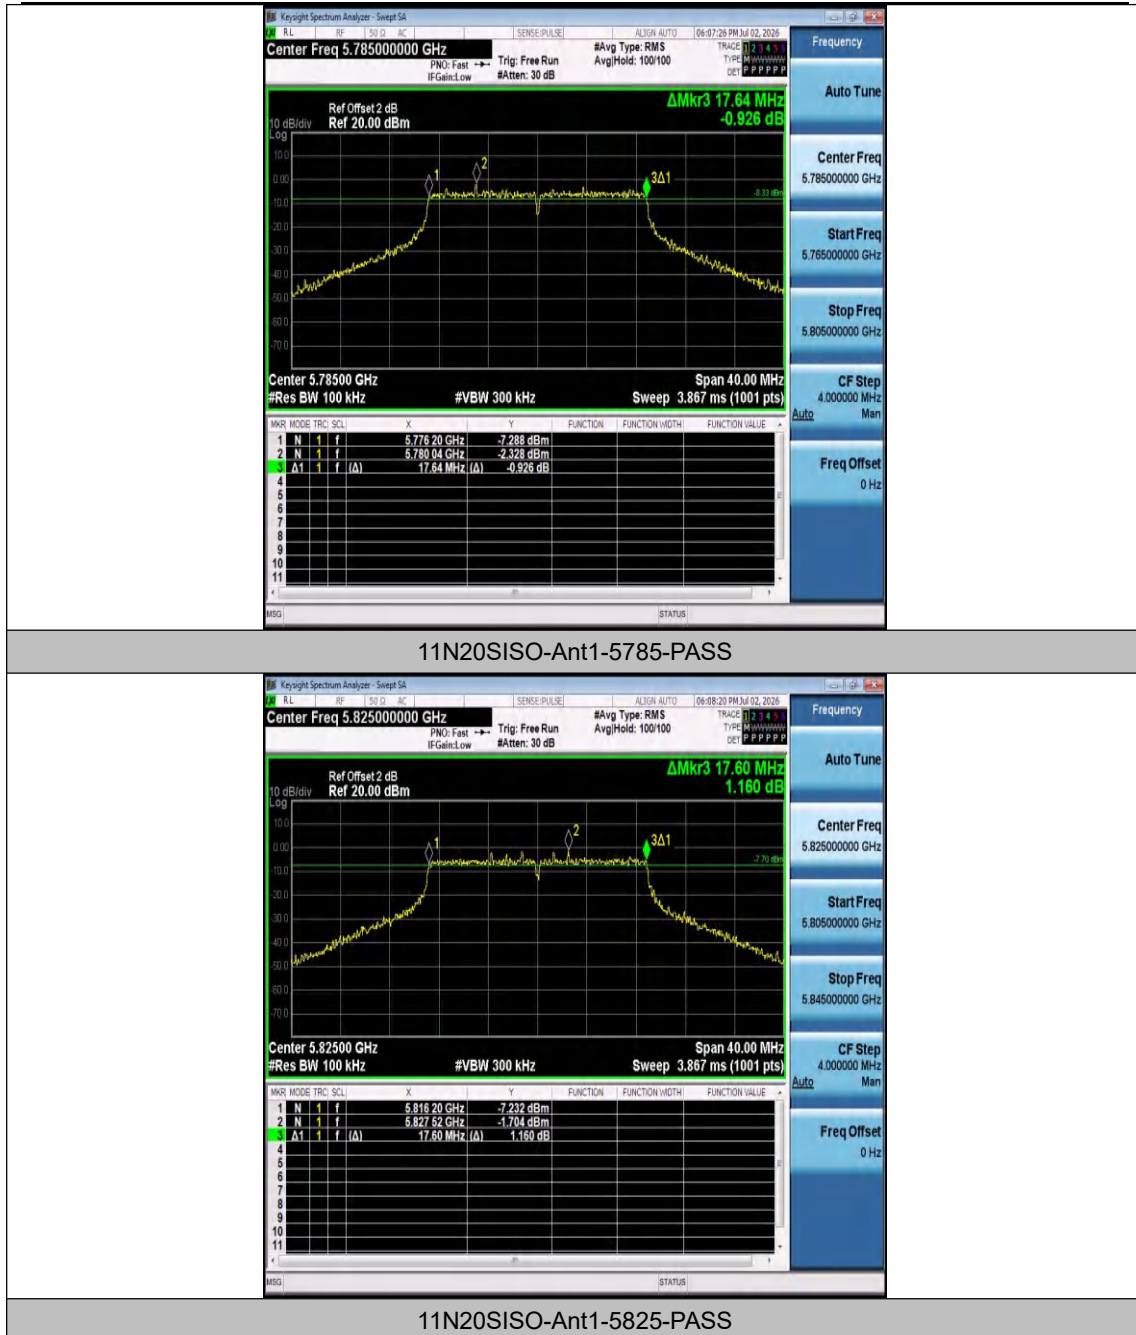


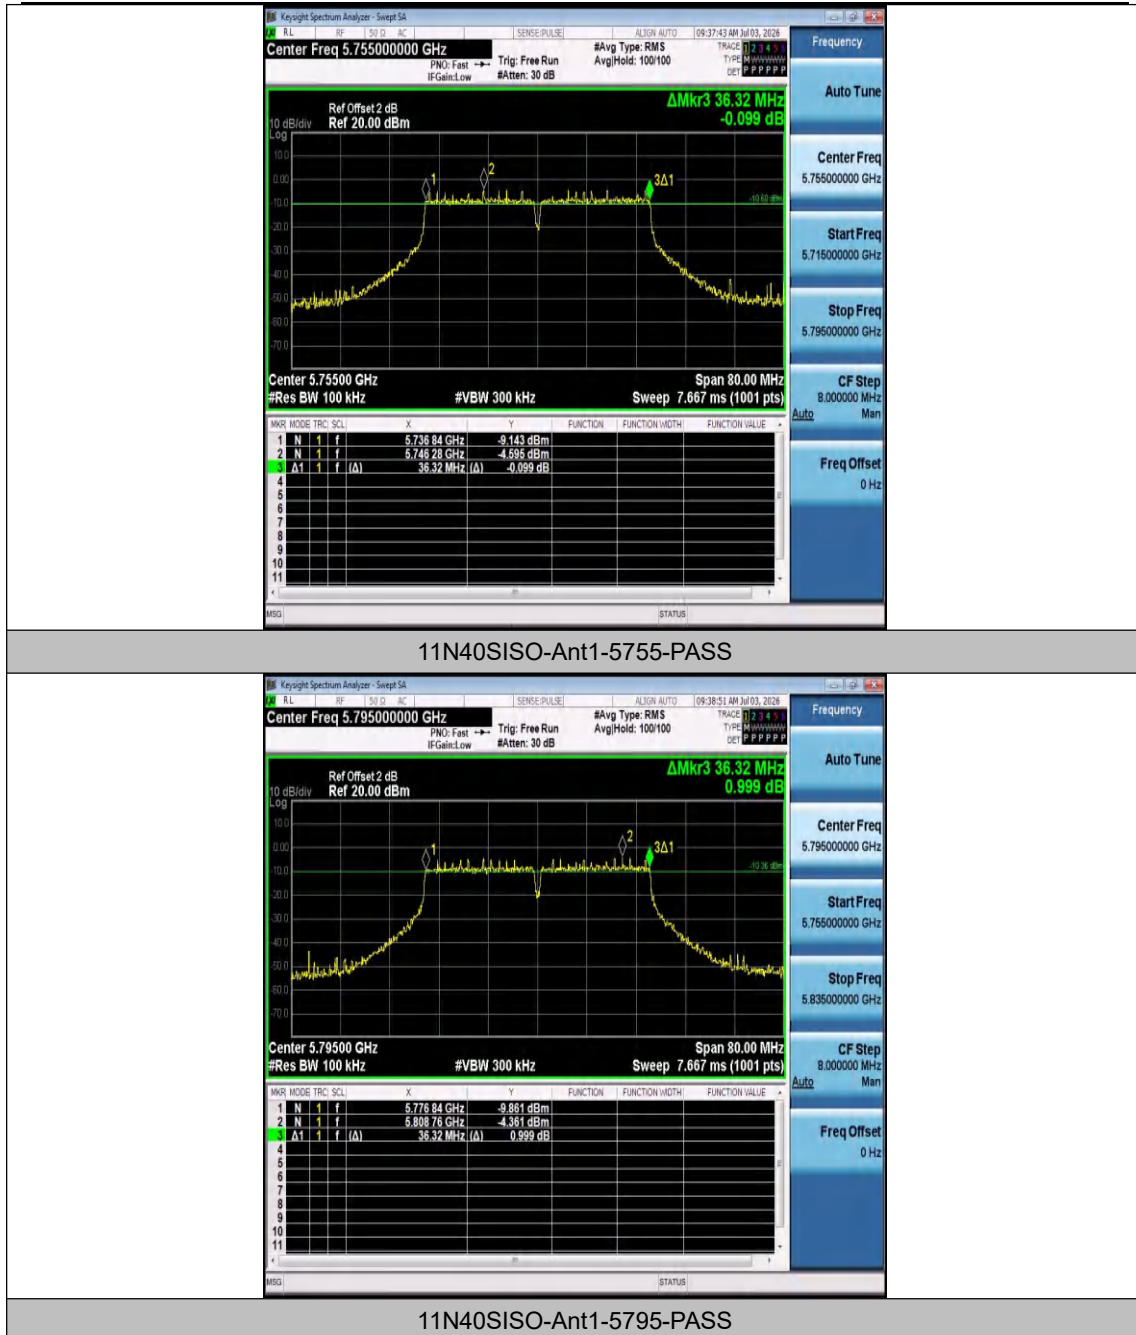



### Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

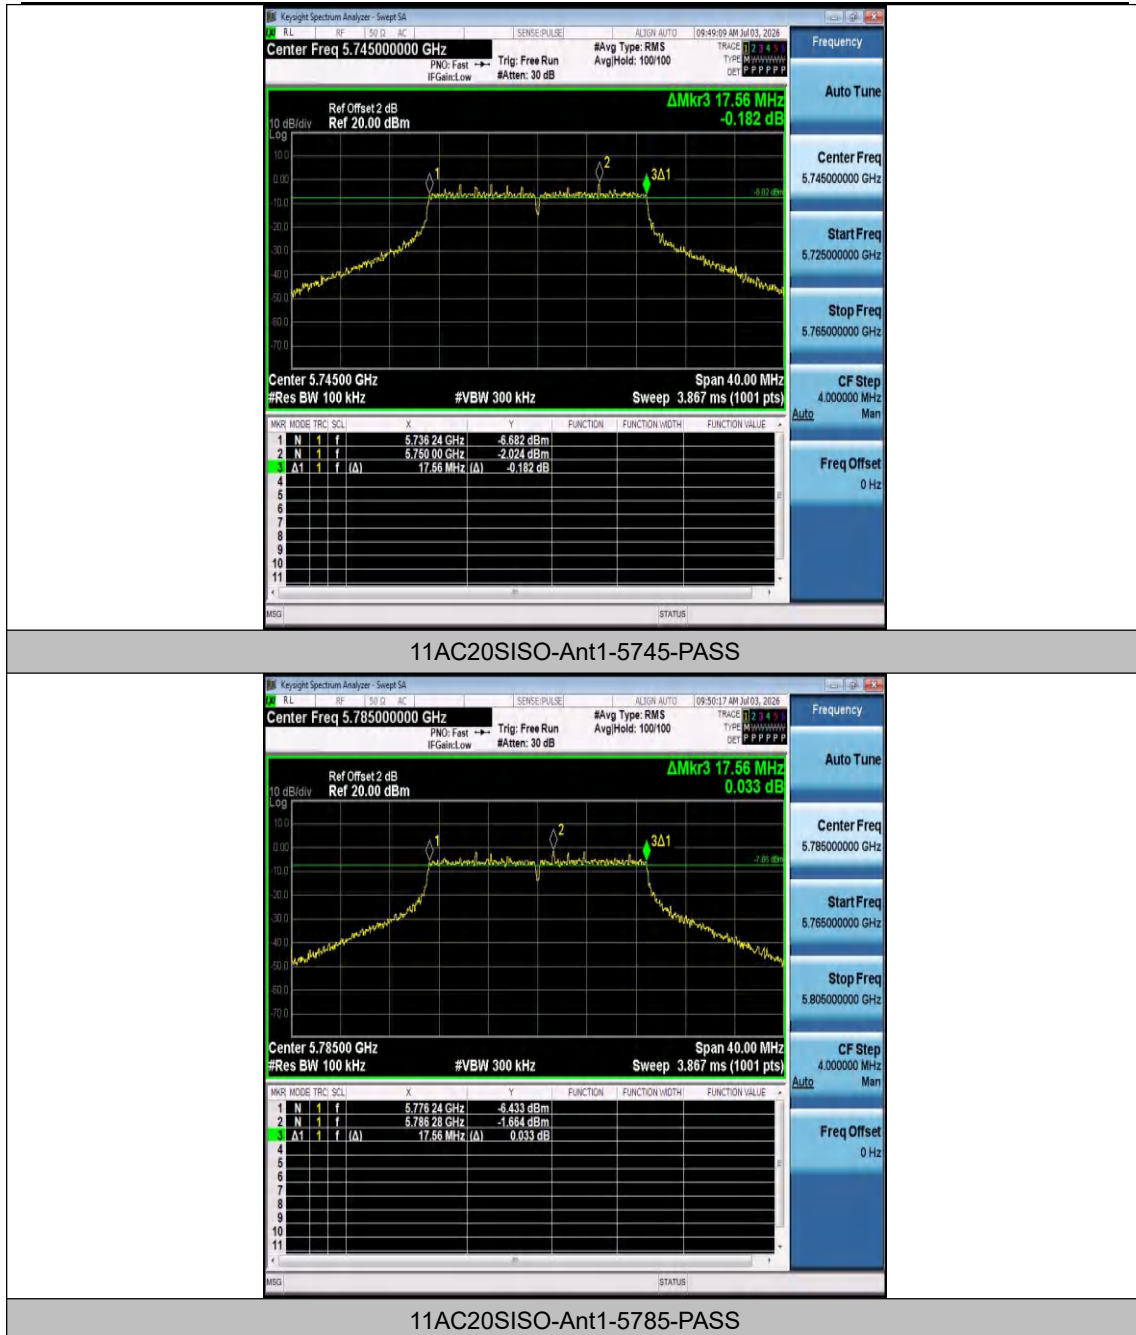

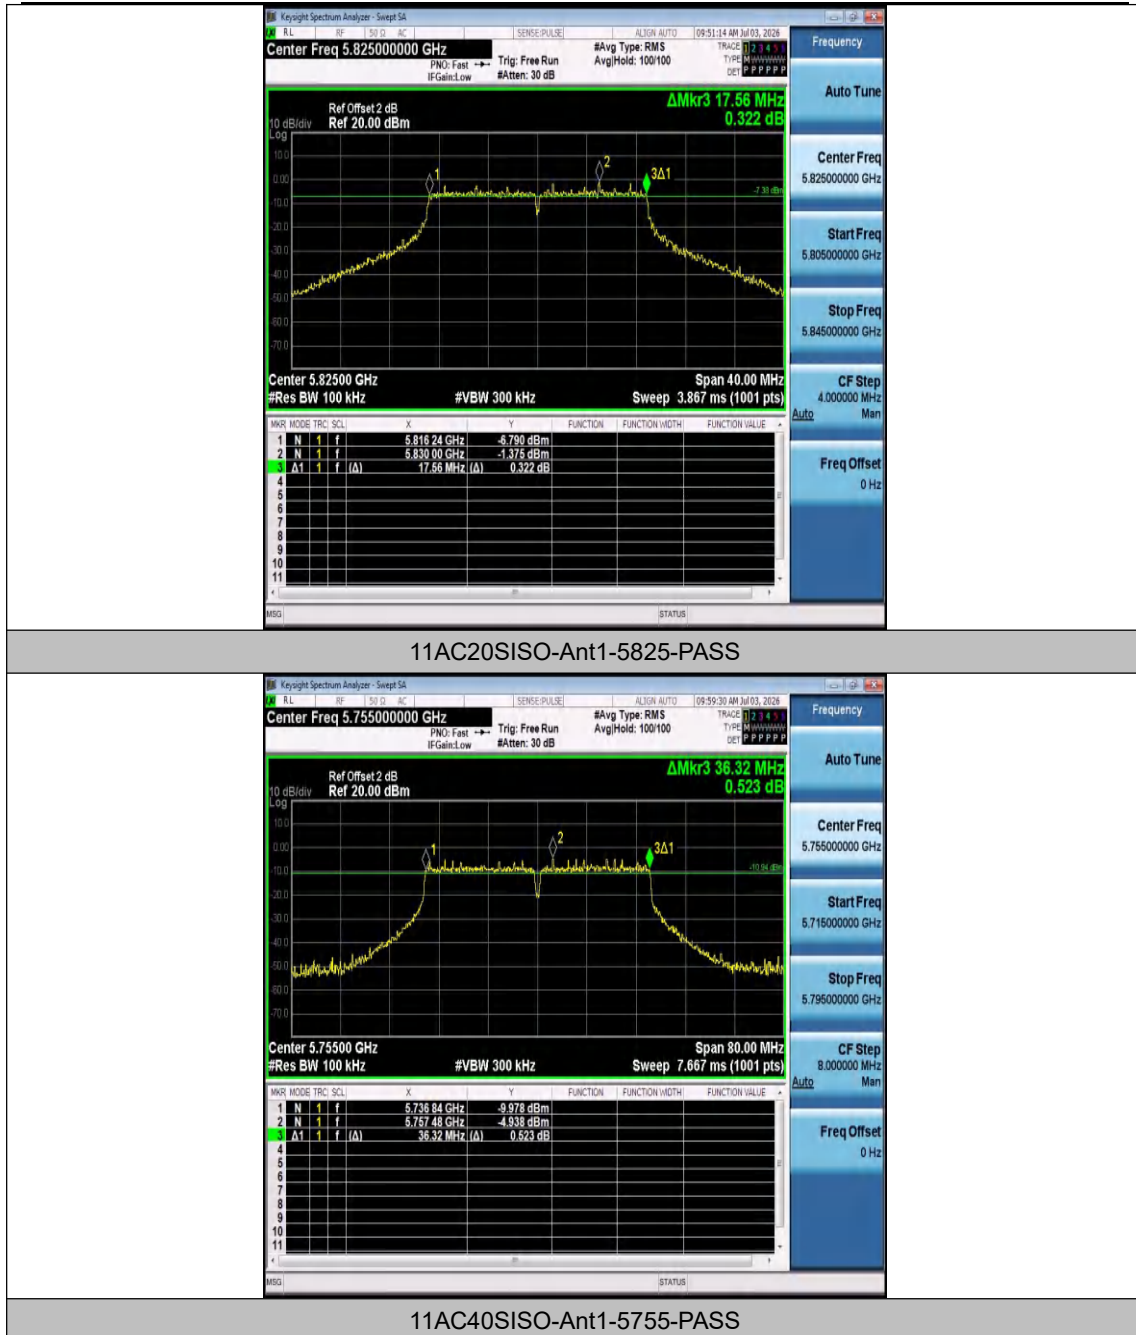

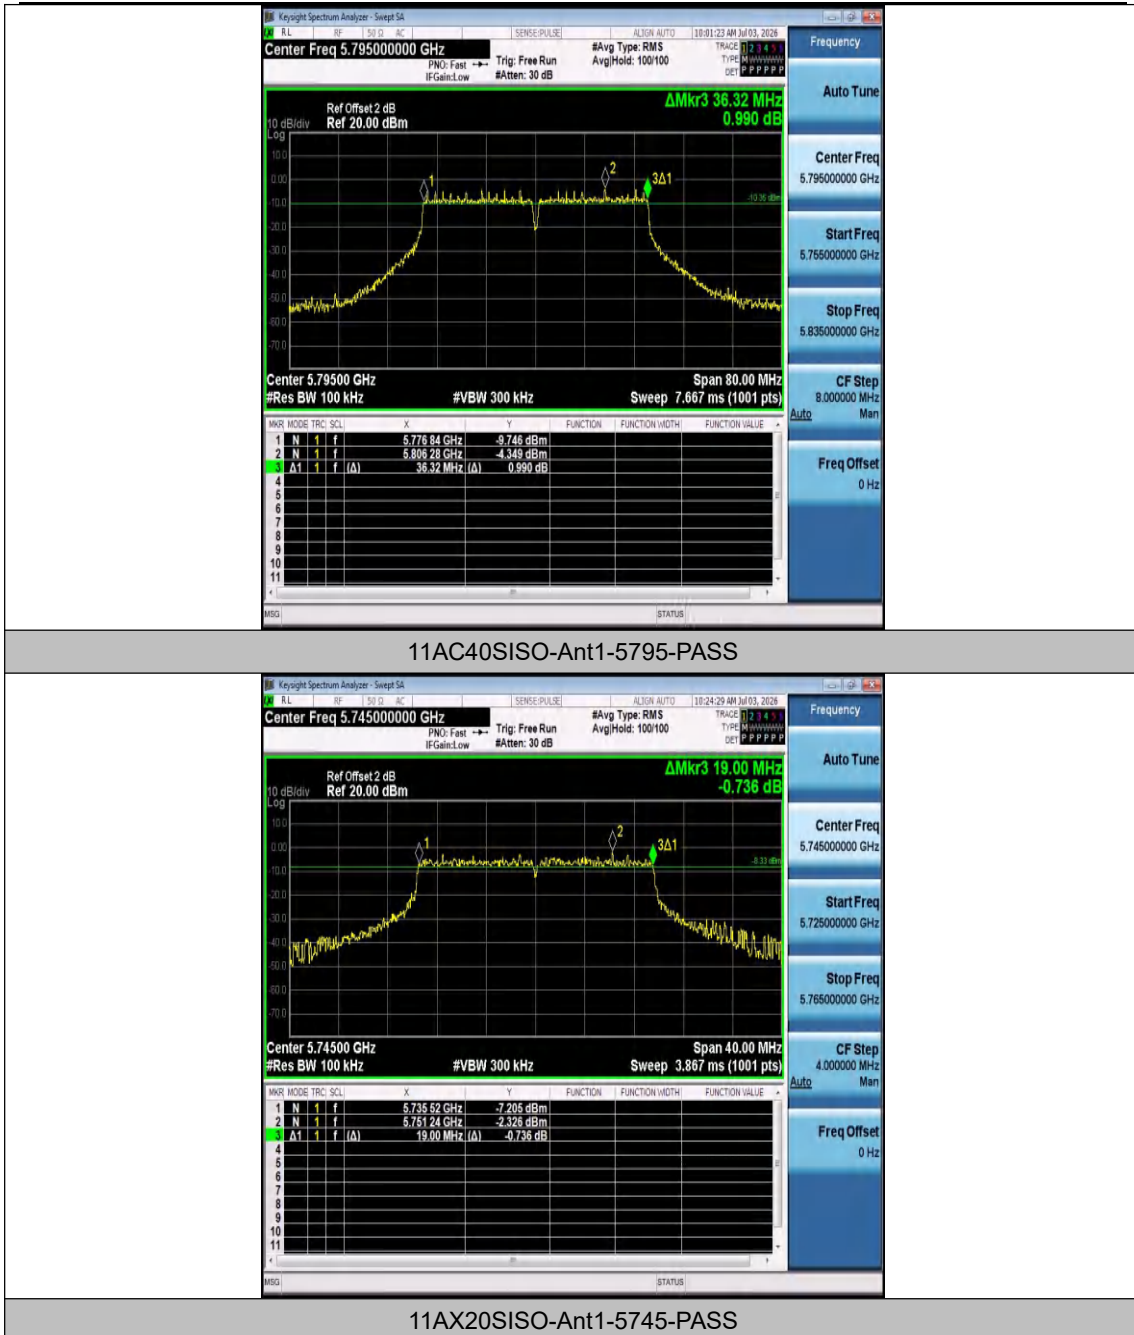

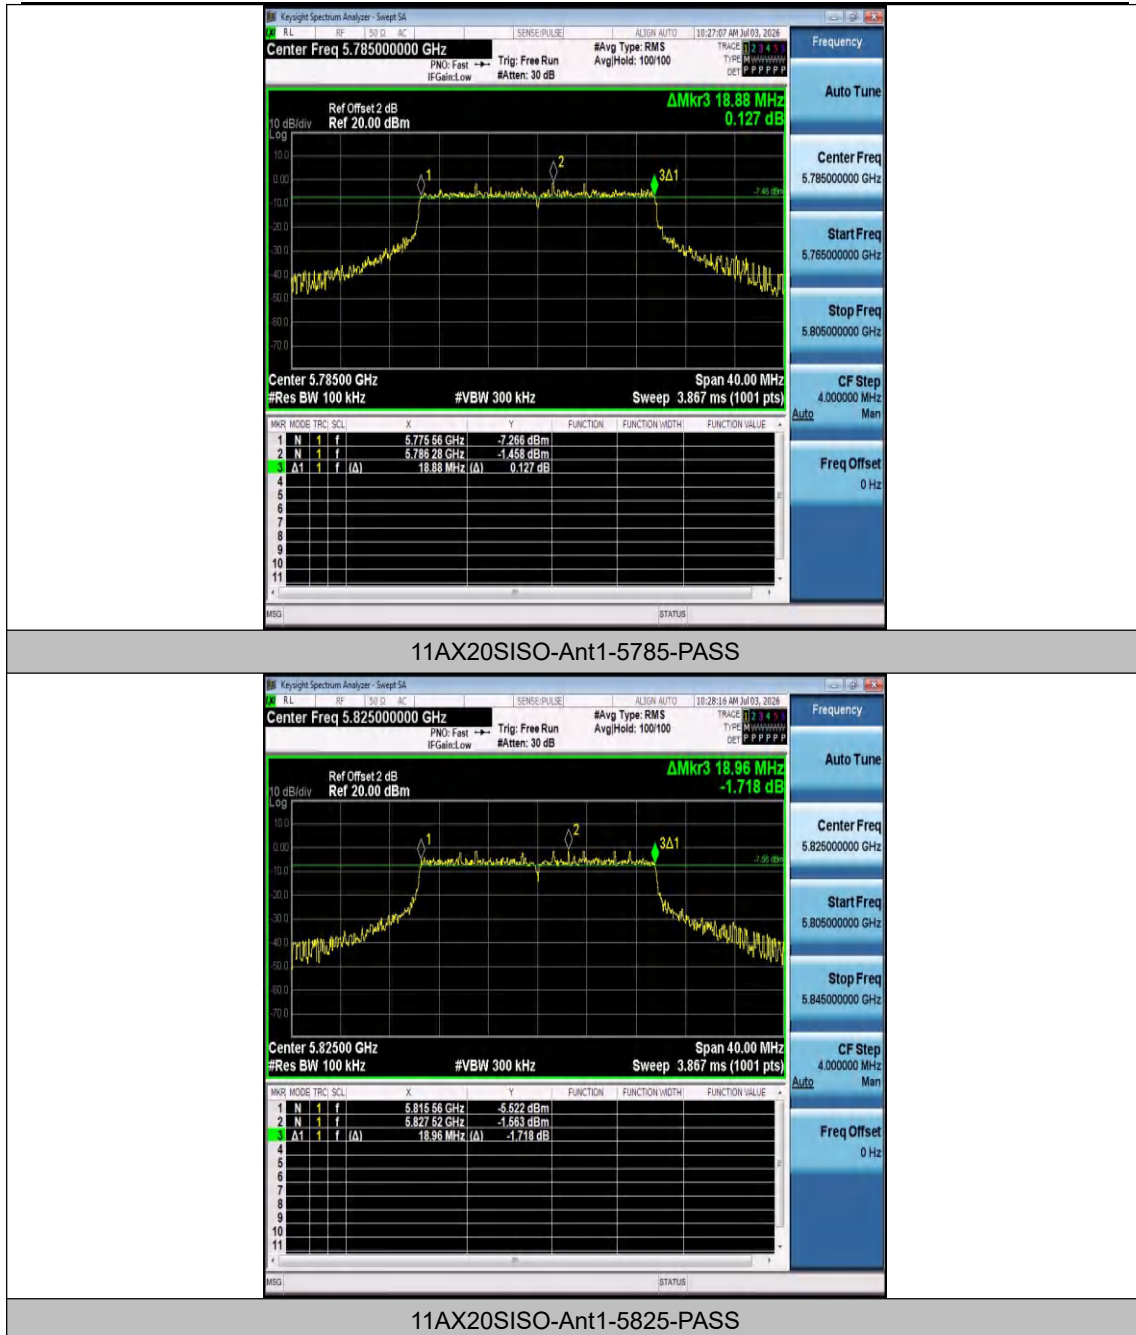

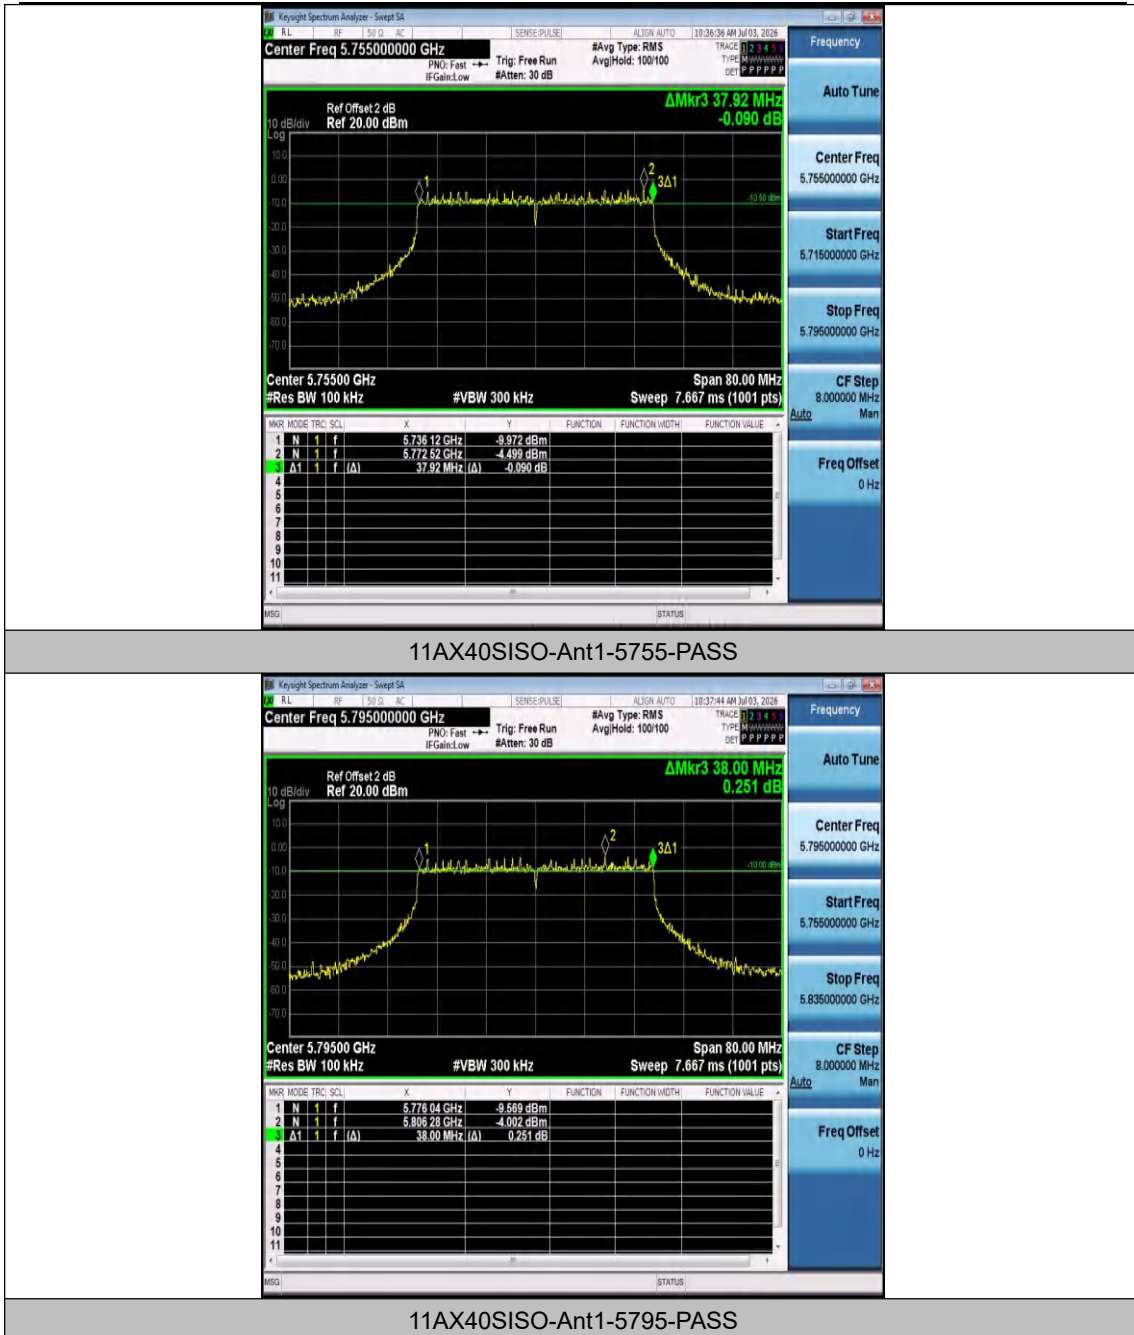

## Appendix B: Duty Cycle

### Test Result

| Test Mode  | Antenna | Frequency[MHz] | Transmission Duration [ms] | Transmission Period [ms] | Duty Cycle [%] | Dc Factor [dB] | 1/T  |
|------------|---------|----------------|----------------------------|--------------------------|----------------|----------------|------|
| 11A        | Ant1    | 5180           | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11A        | Ant1    | 5220           | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11A        | Ant1    | 5240           | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11A        | Ant1    | 5260           | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11A        | Ant1    | 5300           | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11A        | Ant1    | 5320           | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11A        | Ant1    | 5500           | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11A        | Ant1    | 5580           | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11A        | Ant1    | 5700           | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11A        | Ant1    | 5745           | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11A        | Ant1    | 5785           | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11A        | Ant1    | 5825           | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11N20SISO  | Ant1    | 5180           | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11N20SISO  | Ant1    | 5220           | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11N20SISO  | Ant1    | 5240           | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11N20SISO  | Ant1    | 5260           | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11N20SISO  | Ant1    | 5300           | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11N20SISO  | Ant1    | 5320           | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11N20SISO  | Ant1    | 5500           | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11N20SISO  | Ant1    | 5580           | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11N20SISO  | Ant1    | 5700           | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11N20SISO  | Ant1    | 5745           | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11N20SISO  | Ant1    | 5785           | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11N20SISO  | Ant1    | 5825           | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11N40SISO  | Ant1    | 5190           | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11N40SISO  | Ant1    | 5230           | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11N40SISO  | Ant1    | 5270           | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11N40SISO  | Ant1    | 5310           | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11N40SISO  | Ant1    | 5510           | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11N40SISO  | Ant1    | 5550           | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11N40SISO  | Ant1    | 5670           | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11N40SISO  | Ant1    | 5755           | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11N40SISO  | Ant1    | 5795           | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11AC20SISO | Ant1    | 5180           | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11AC20SISO | Ant1    | 5220           | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11AC20SISO | Ant1    | 5240           | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |


#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

|            |      |      |        |        |        |      |      |
|------------|------|------|--------|--------|--------|------|------|
| 11AC20SISO | Ant1 | 5260 | 100.00 | 100.00 | 100.00 | 0.00 | 0.01 |
| 11AC20SISO | Ant1 | 5300 | 100.00 | 100.00 | 100.00 | 0.00 | 0.01 |
| 11AC20SISO | Ant1 | 5320 | 100.00 | 100.00 | 100.00 | 0.00 | 0.01 |
| 11AC20SISO | Ant1 | 5500 | 100.00 | 100.00 | 100.00 | 0.00 | 0.01 |
| 11AC20SISO | Ant1 | 5580 | 100.00 | 100.00 | 100.00 | 0.00 | 0.01 |
| 11AC20SISO | Ant1 | 5700 | 100.00 | 100.00 | 100.00 | 0.00 | 0.01 |
| 11AC20SISO | Ant1 | 5745 | 100.00 | 100.00 | 100.00 | 0.00 | 0.01 |
| 11AC20SISO | Ant1 | 5785 | 100.00 | 100.00 | 100.00 | 0.00 | 0.01 |
| 11AC20SISO | Ant1 | 5825 | 100.00 | 100.00 | 100.00 | 0.00 | 0.01 |
| 11AC40SISO | Ant1 | 5190 | 100.00 | 100.00 | 100.00 | 0.00 | 0.01 |
| 11AC40SISO | Ant1 | 5230 | 100.00 | 100.00 | 100.00 | 0.00 | 0.01 |
| 11AC40SISO | Ant1 | 5270 | 100.00 | 100.00 | 100.00 | 0.00 | 0.01 |
| 11AC40SISO | Ant1 | 5310 | 100.00 | 100.00 | 100.00 | 0.00 | 0.01 |
| 11AC40SISO | Ant1 | 5510 | 100.00 | 100.00 | 100.00 | 0.00 | 0.01 |
| 11AC40SISO | Ant1 | 5550 | 100.00 | 100.00 | 100.00 | 0.00 | 0.01 |
| 11AC40SISO | Ant1 | 5670 | 100.00 | 100.00 | 100.00 | 0.00 | 0.01 |
| 11AC40SISO | Ant1 | 5755 | 100.00 | 100.00 | 100.00 | 0.00 | 0.01 |
| 11AC40SISO | Ant1 | 5795 | 100.00 | 100.00 | 100.00 | 0.00 | 0.01 |
| 11AX20SISO | Ant1 | 5180 | 100.00 | 100.00 | 100.00 | 0.00 | 0.01 |
| 11AX20SISO | Ant1 | 5220 | 100.00 | 100.00 | 100.00 | 0.00 | 0.01 |
| 11AX20SISO | Ant1 | 5240 | 100.00 | 100.00 | 100.00 | 0.00 | 0.01 |
| 11AX20SISO | Ant1 | 5260 | 100.00 | 100.00 | 100.00 | 0.00 | 0.01 |
| 11AX20SISO | Ant1 | 5300 | 100.00 | 100.00 | 100.00 | 0.00 | 0.01 |
| 11AX20SISO | Ant1 | 5320 | 100.00 | 100.00 | 100.00 | 0.00 | 0.01 |
| 11AX20SISO | Ant1 | 5500 | 100.00 | 100.00 | 100.00 | 0.00 | 0.01 |
| 11AX20SISO | Ant1 | 5580 | 100.00 | 100.00 | 100.00 | 0.00 | 0.01 |
| 11AX20SISO | Ant1 | 5700 | 100.00 | 100.00 | 100.00 | 0.00 | 0.01 |
| 11AX20SISO | Ant1 | 5745 | 100.00 | 100.00 | 100.00 | 0.00 | 0.01 |
| 11AX20SISO | Ant1 | 5785 | 100.00 | 100.00 | 100.00 | 0.00 | 0.01 |
| 11AX20SISO | Ant1 | 5825 | 100.00 | 100.00 | 100.00 | 0.00 | 0.01 |
| 11AX40SISO | Ant1 | 5190 | 100.00 | 100.00 | 100.00 | 0.00 | 0.01 |
| 11AX40SISO | Ant1 | 5230 | 100.00 | 100.00 | 100.00 | 0.00 | 0.01 |
| 11AX40SISO | Ant1 | 5270 | 100.00 | 100.00 | 100.00 | 0.00 | 0.01 |
| 11AX40SISO | Ant1 | 5310 | 100.00 | 100.00 | 100.00 | 0.00 | 0.01 |
| 11AX40SISO | Ant1 | 5510 | 100.00 | 100.00 | 100.00 | 0.00 | 0.01 |
| 11AX40SISO | Ant1 | 5550 | 100.00 | 100.00 | 100.00 | 0.00 | 0.01 |
| 11AX40SISO | Ant1 | 5670 | 100.00 | 100.00 | 100.00 | 0.00 | 0.01 |
| 11AX40SISO | Ant1 | 5755 | 100.00 | 100.00 | 100.00 | 0.00 | 0.01 |
| 11AX40SISO | Ant1 | 5795 | 100.00 | 100.00 | 100.00 | 0.00 | 0.01 |


## Test Graphs

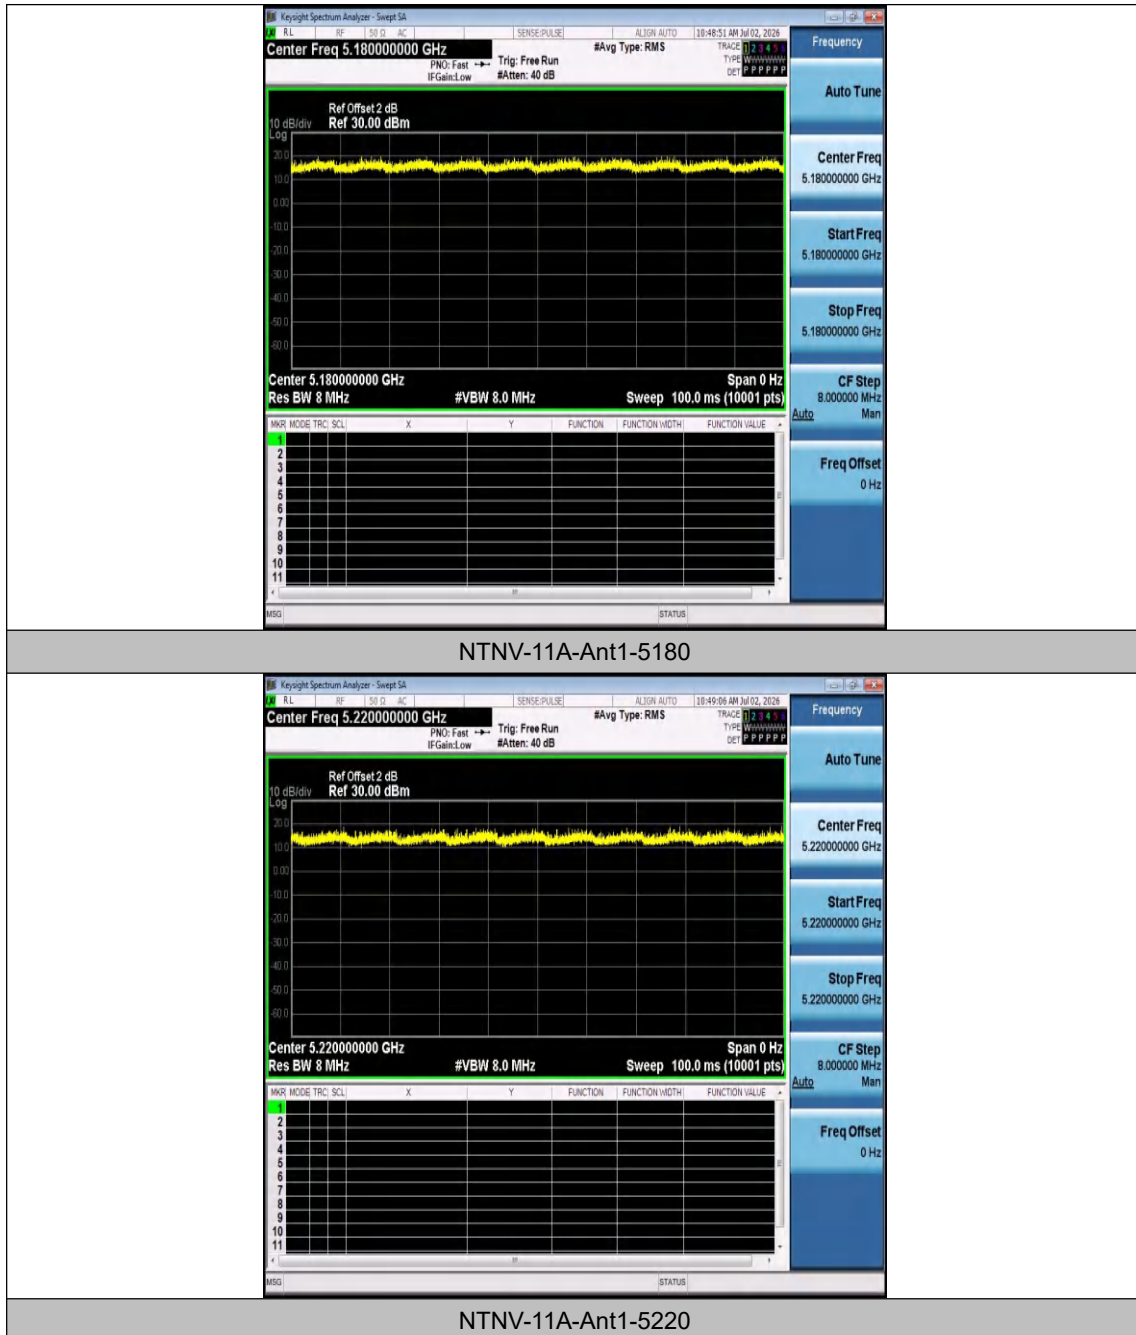

## Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

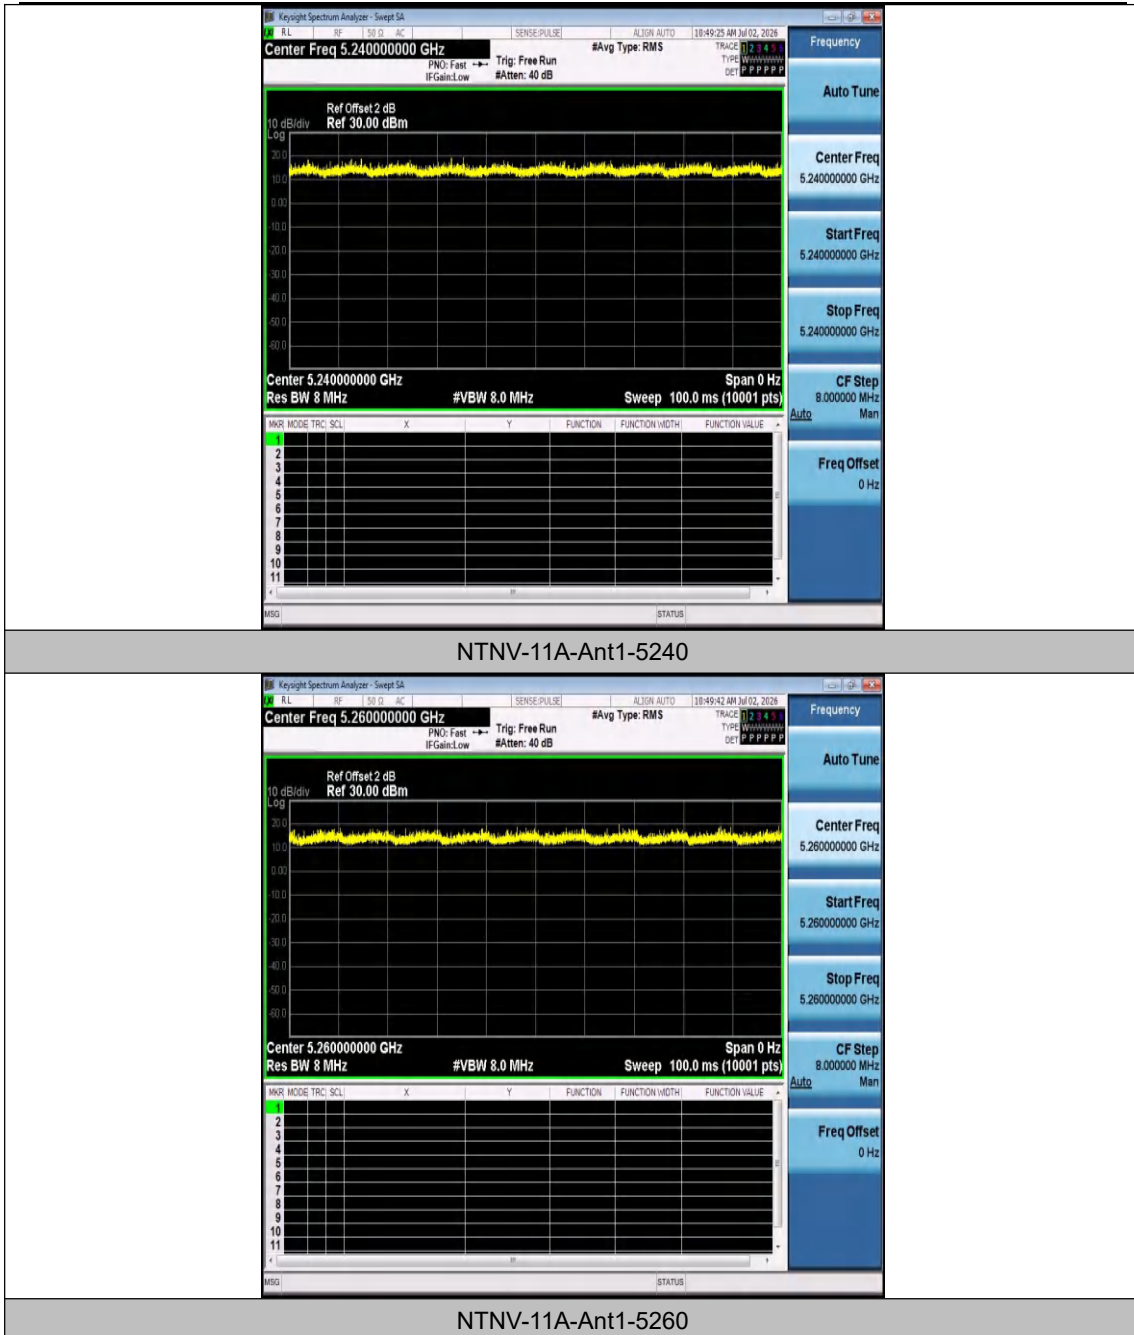

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

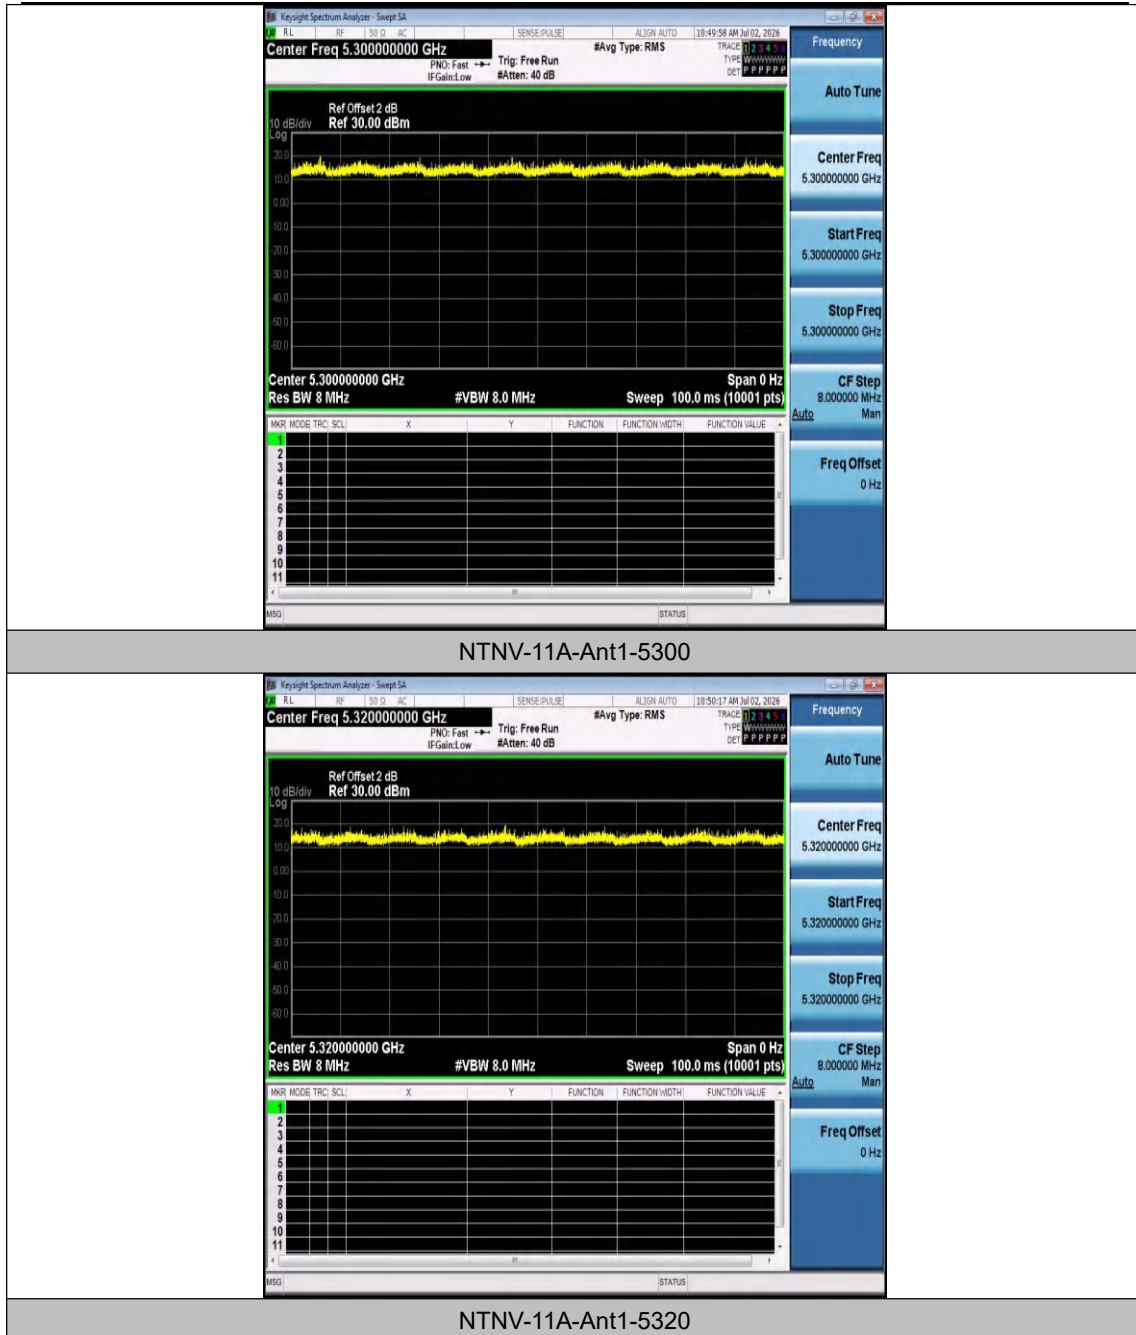

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

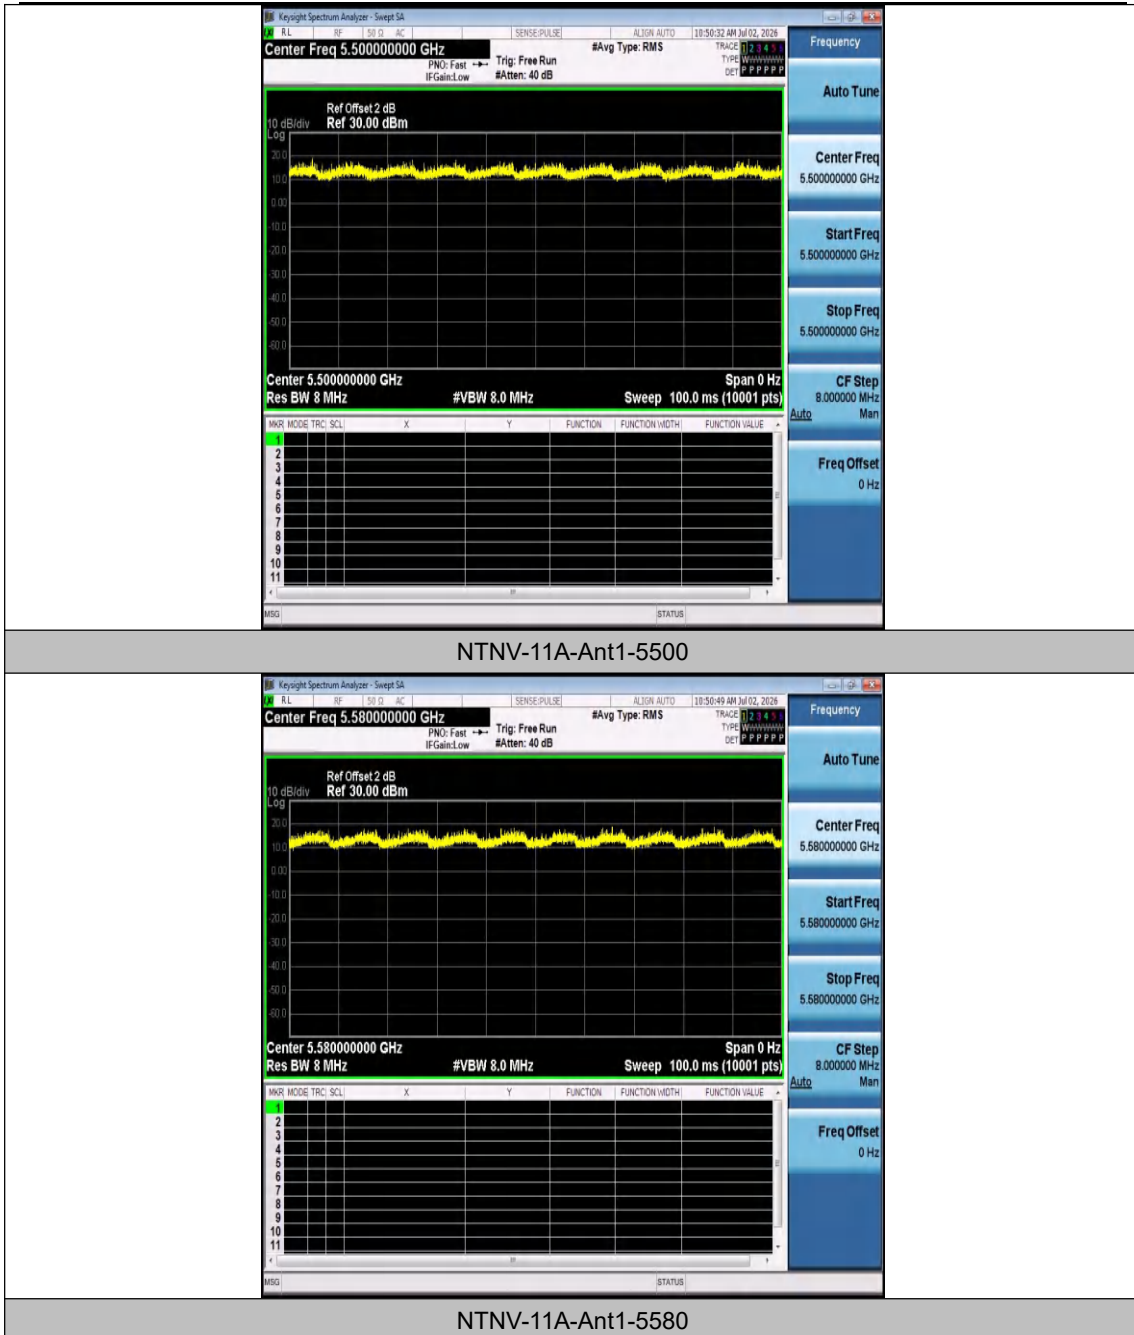


#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

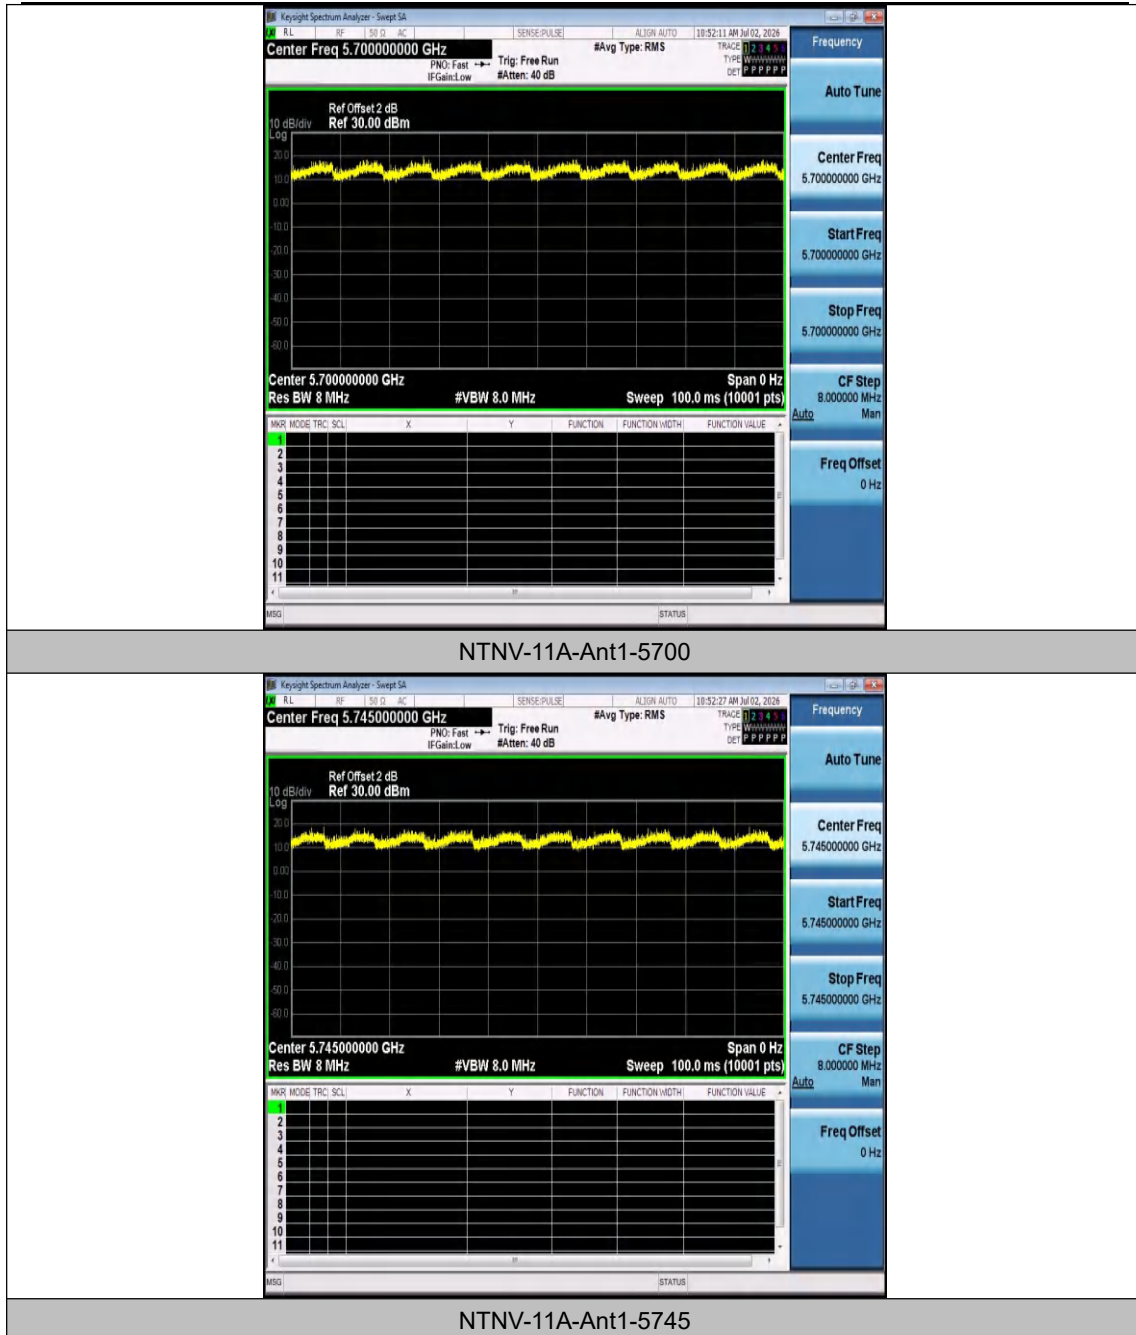


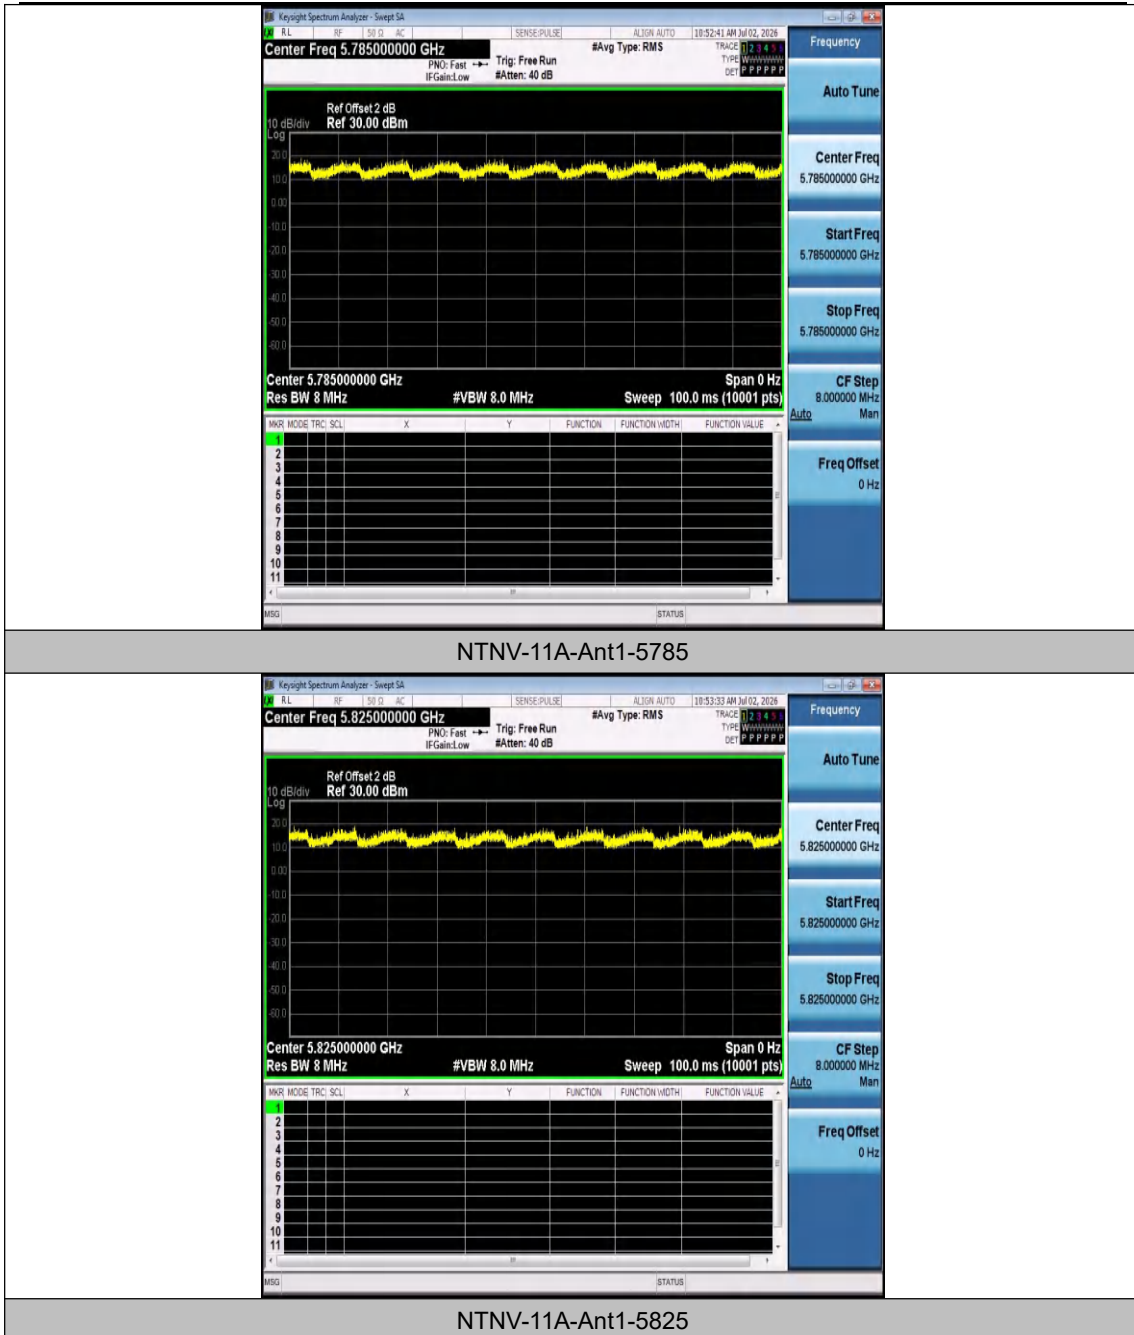

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

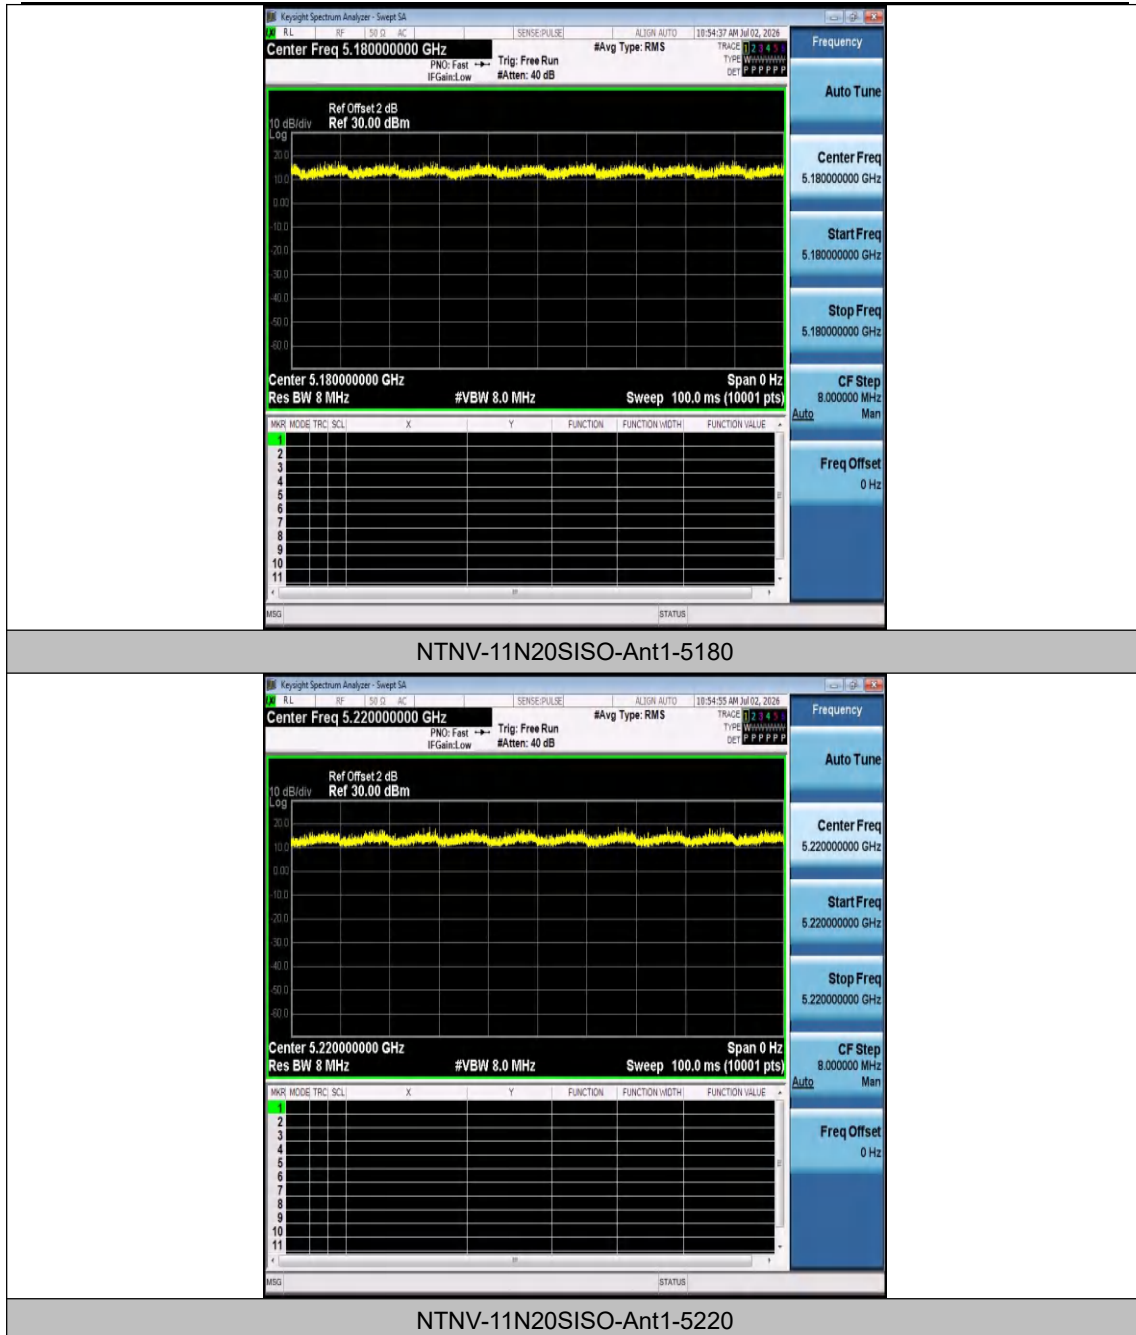

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

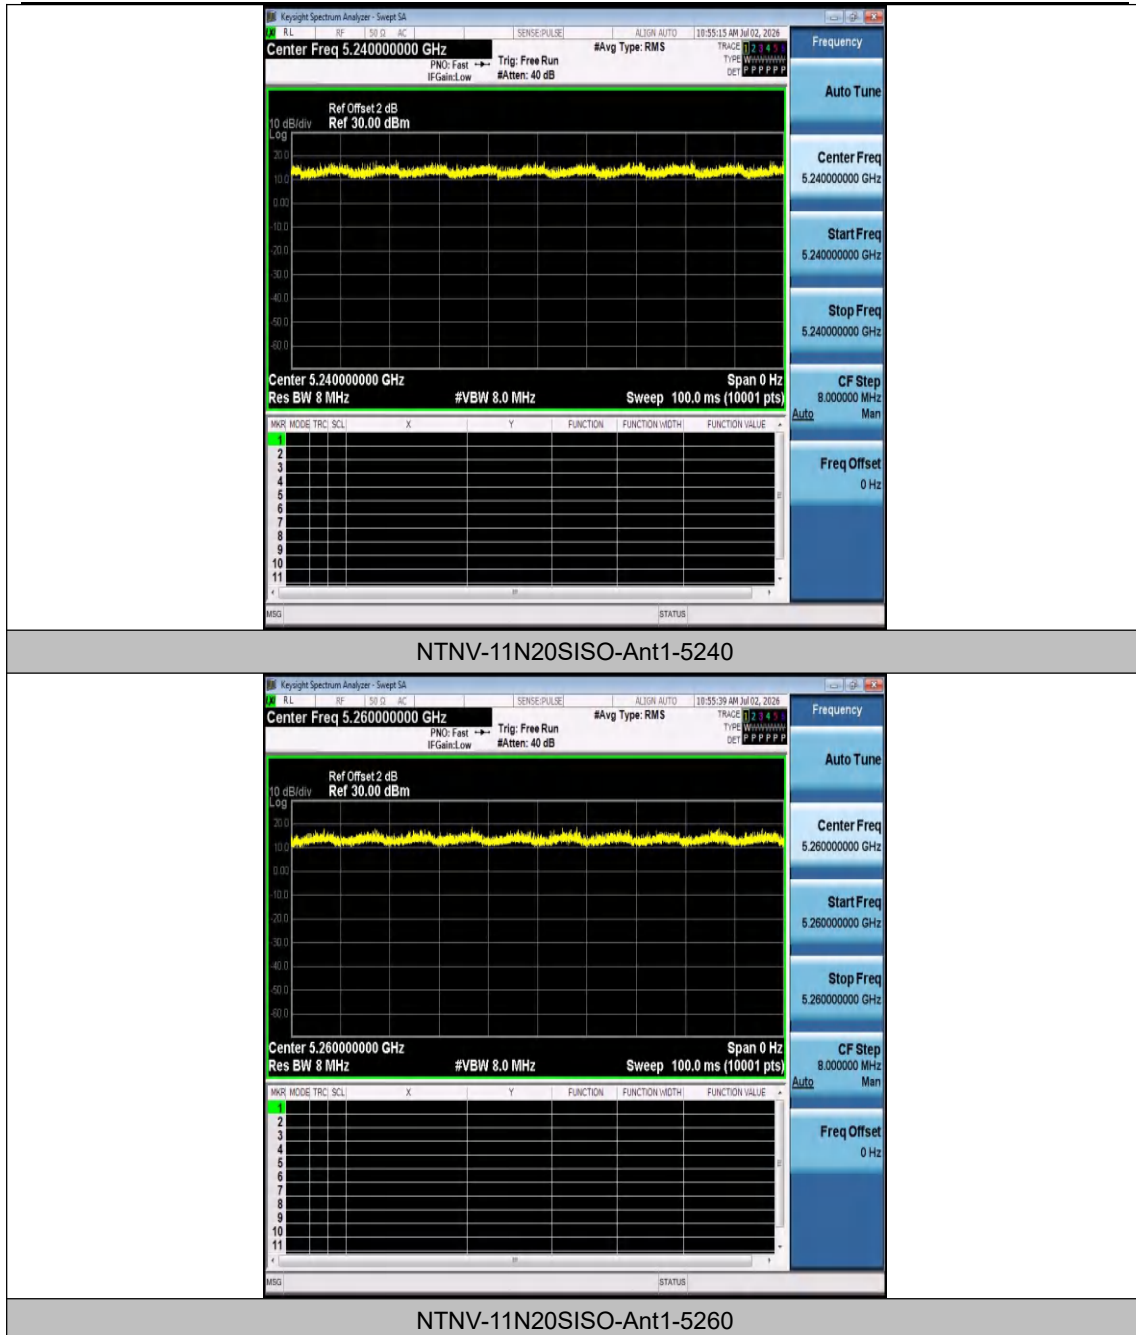

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

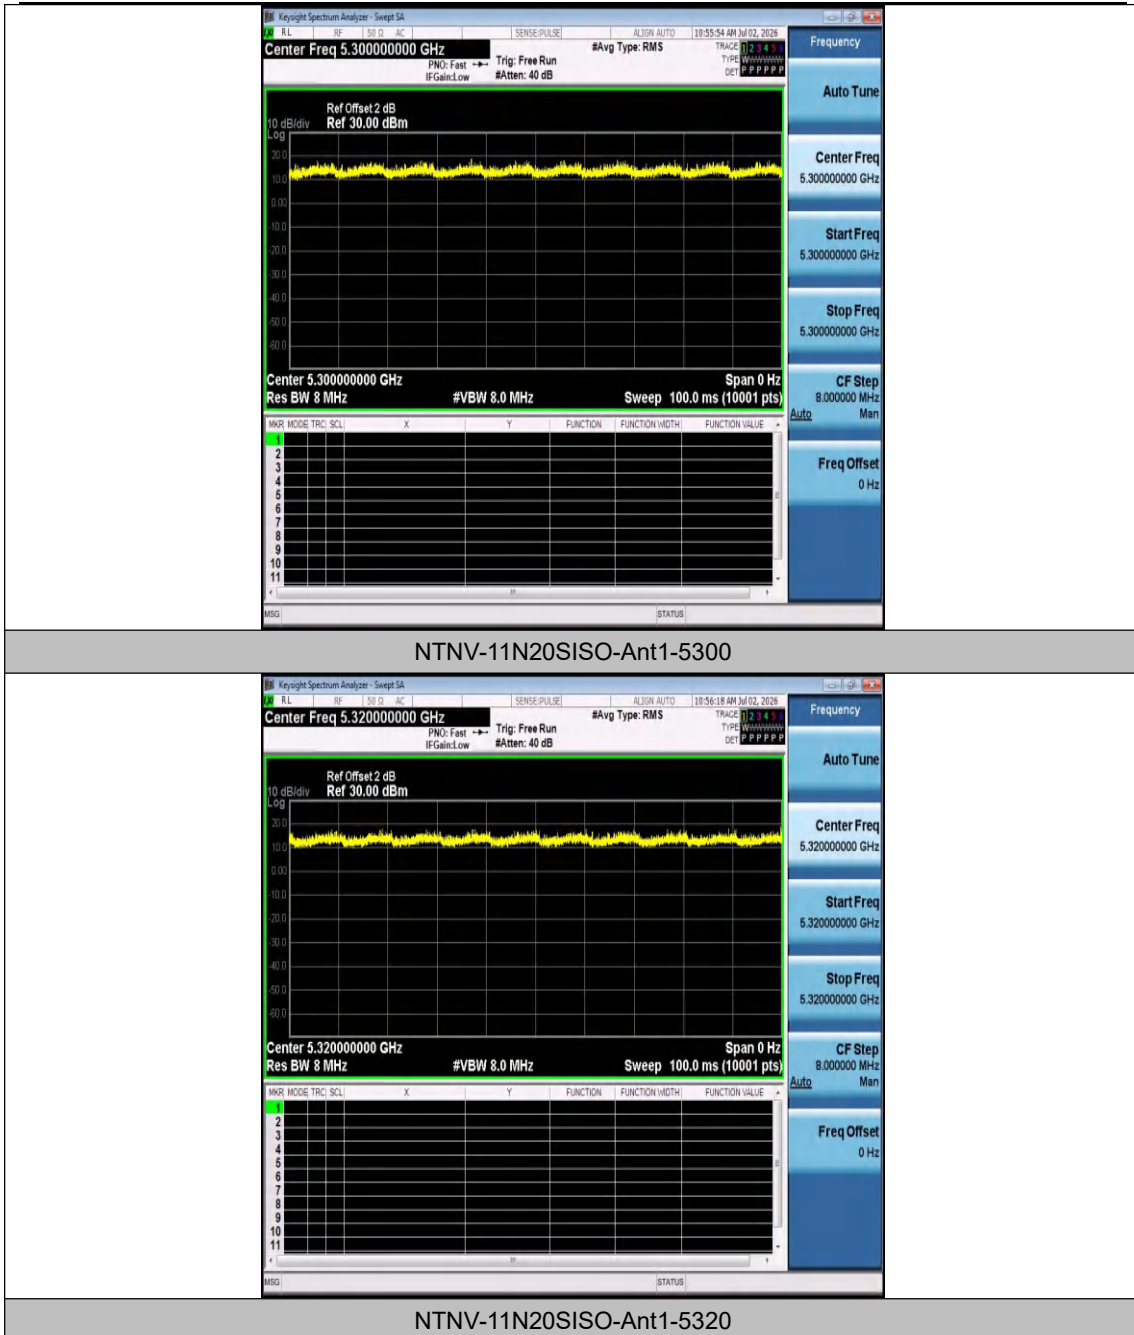

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

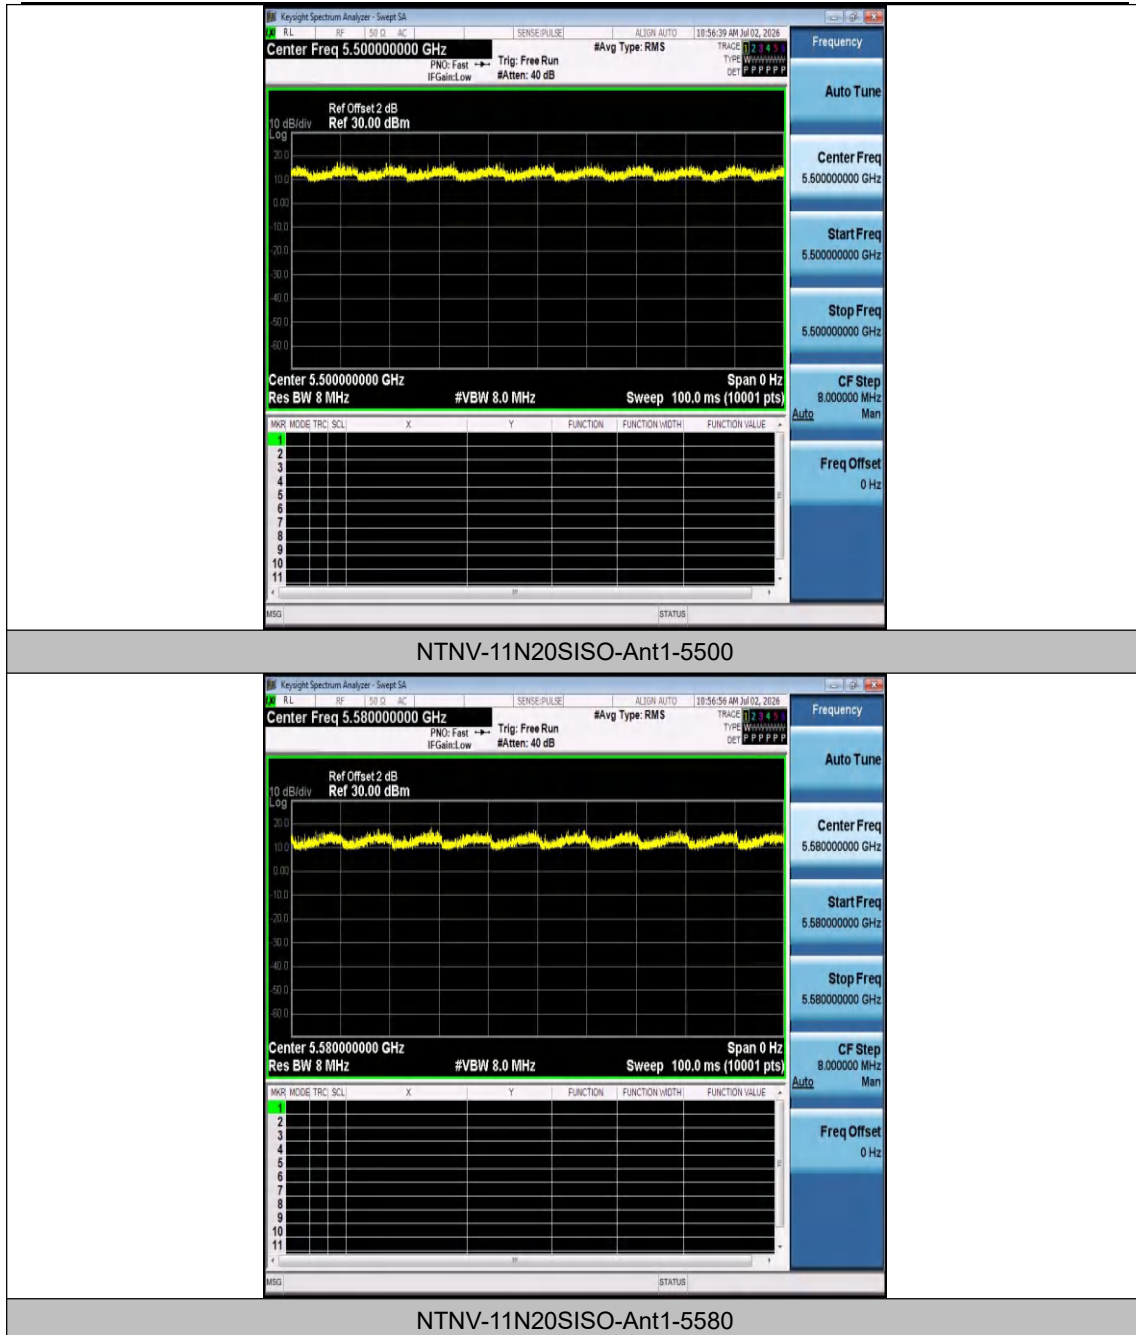

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

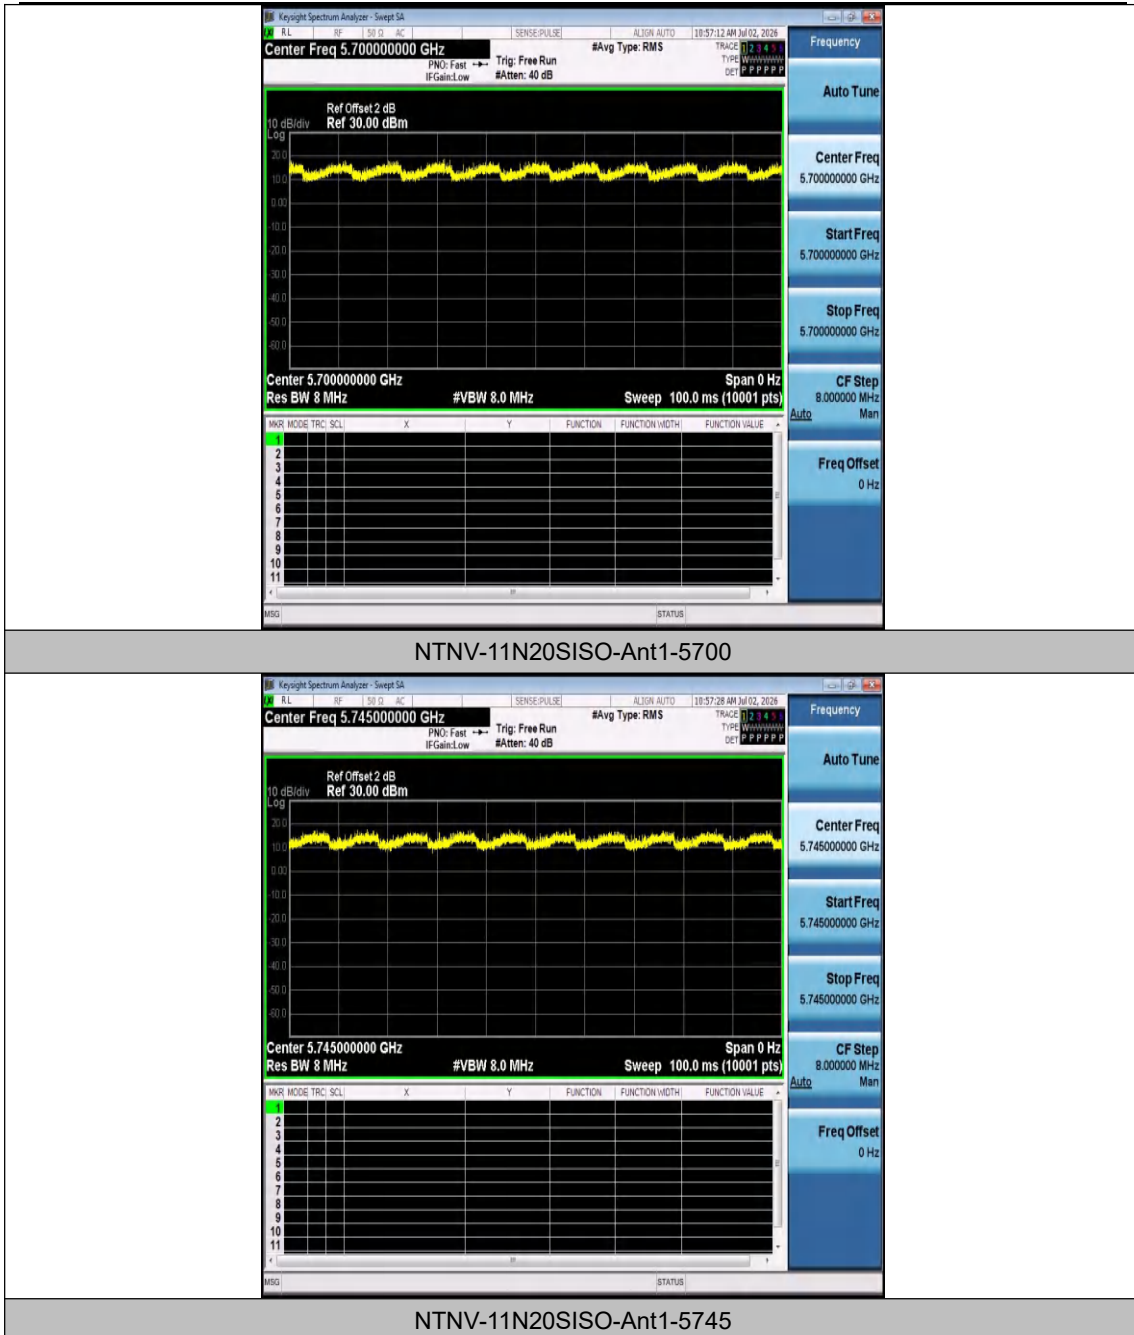

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

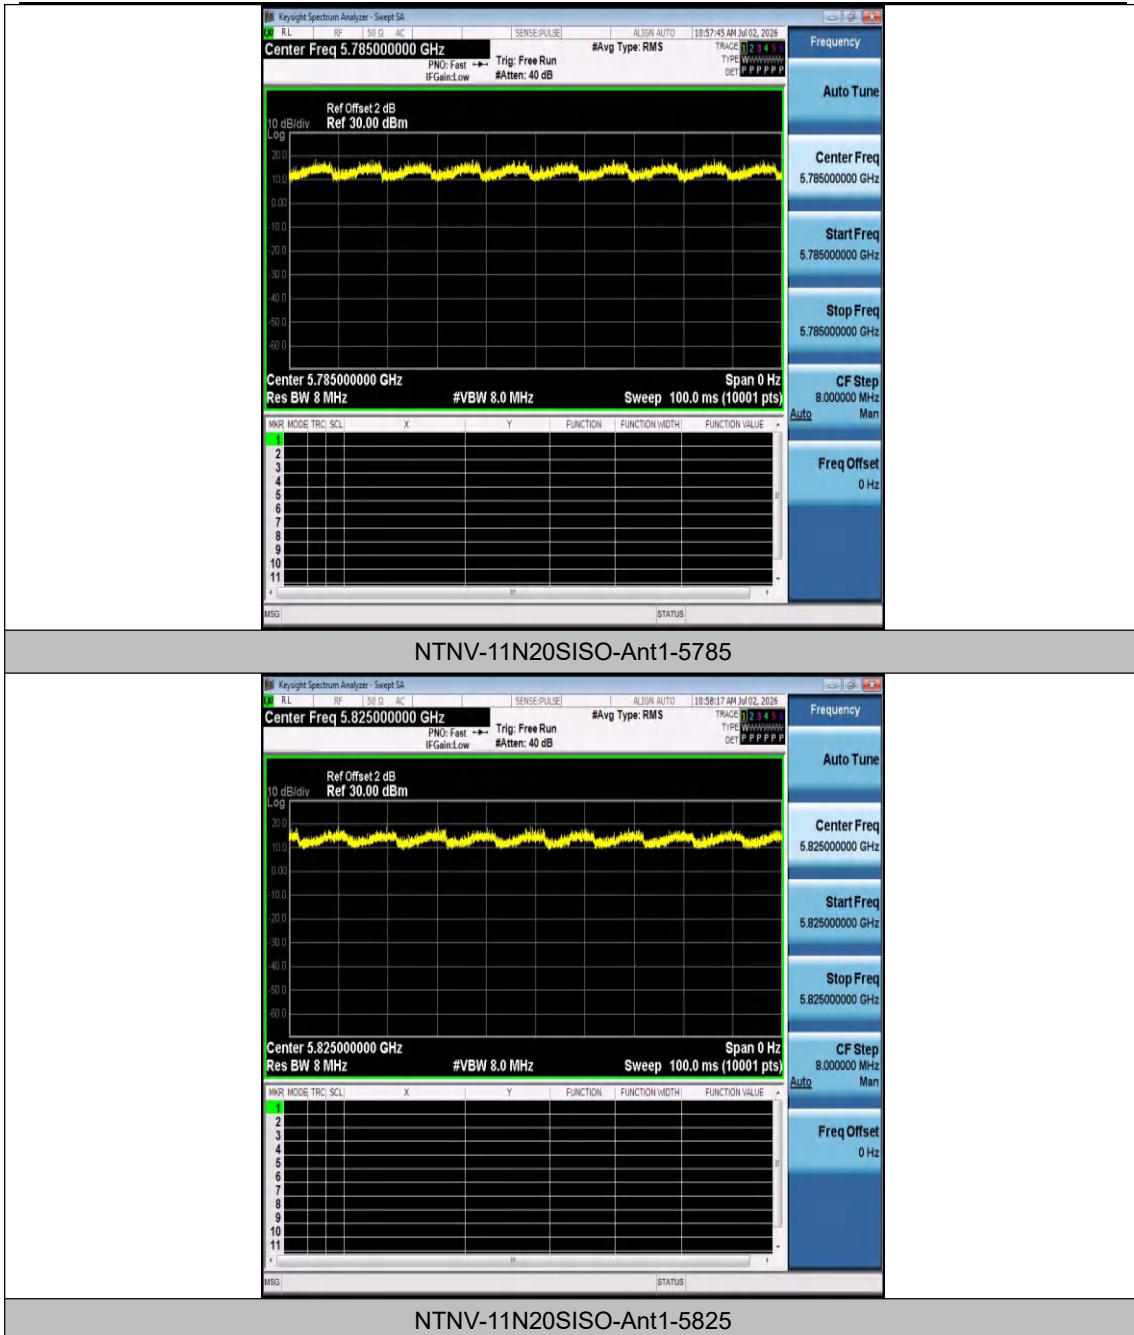

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

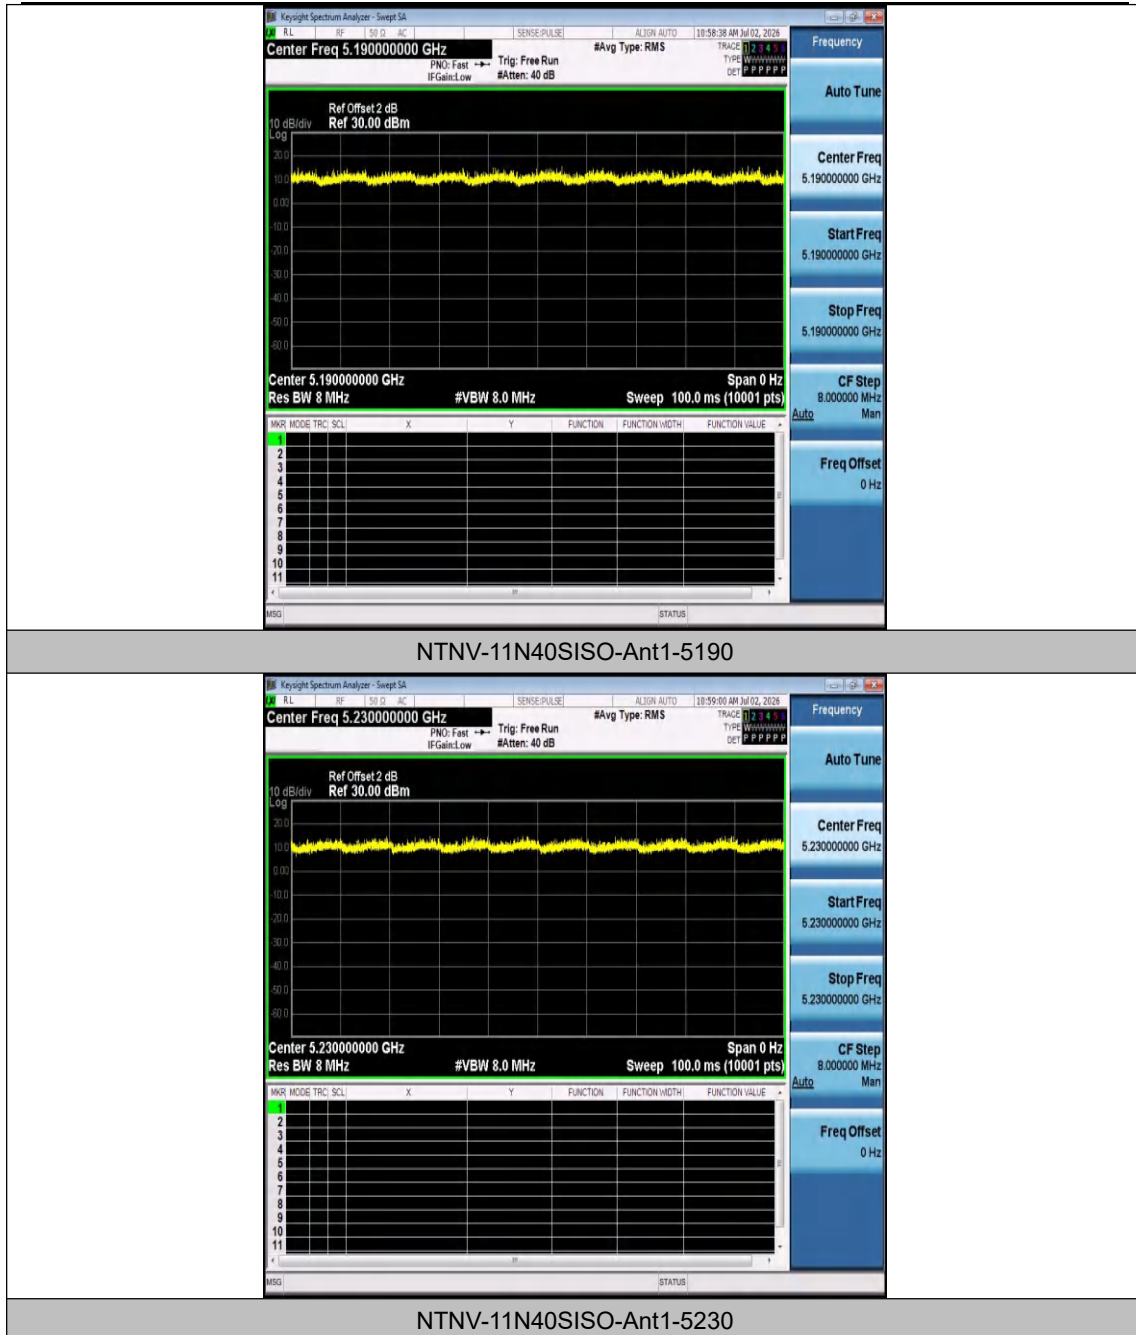

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

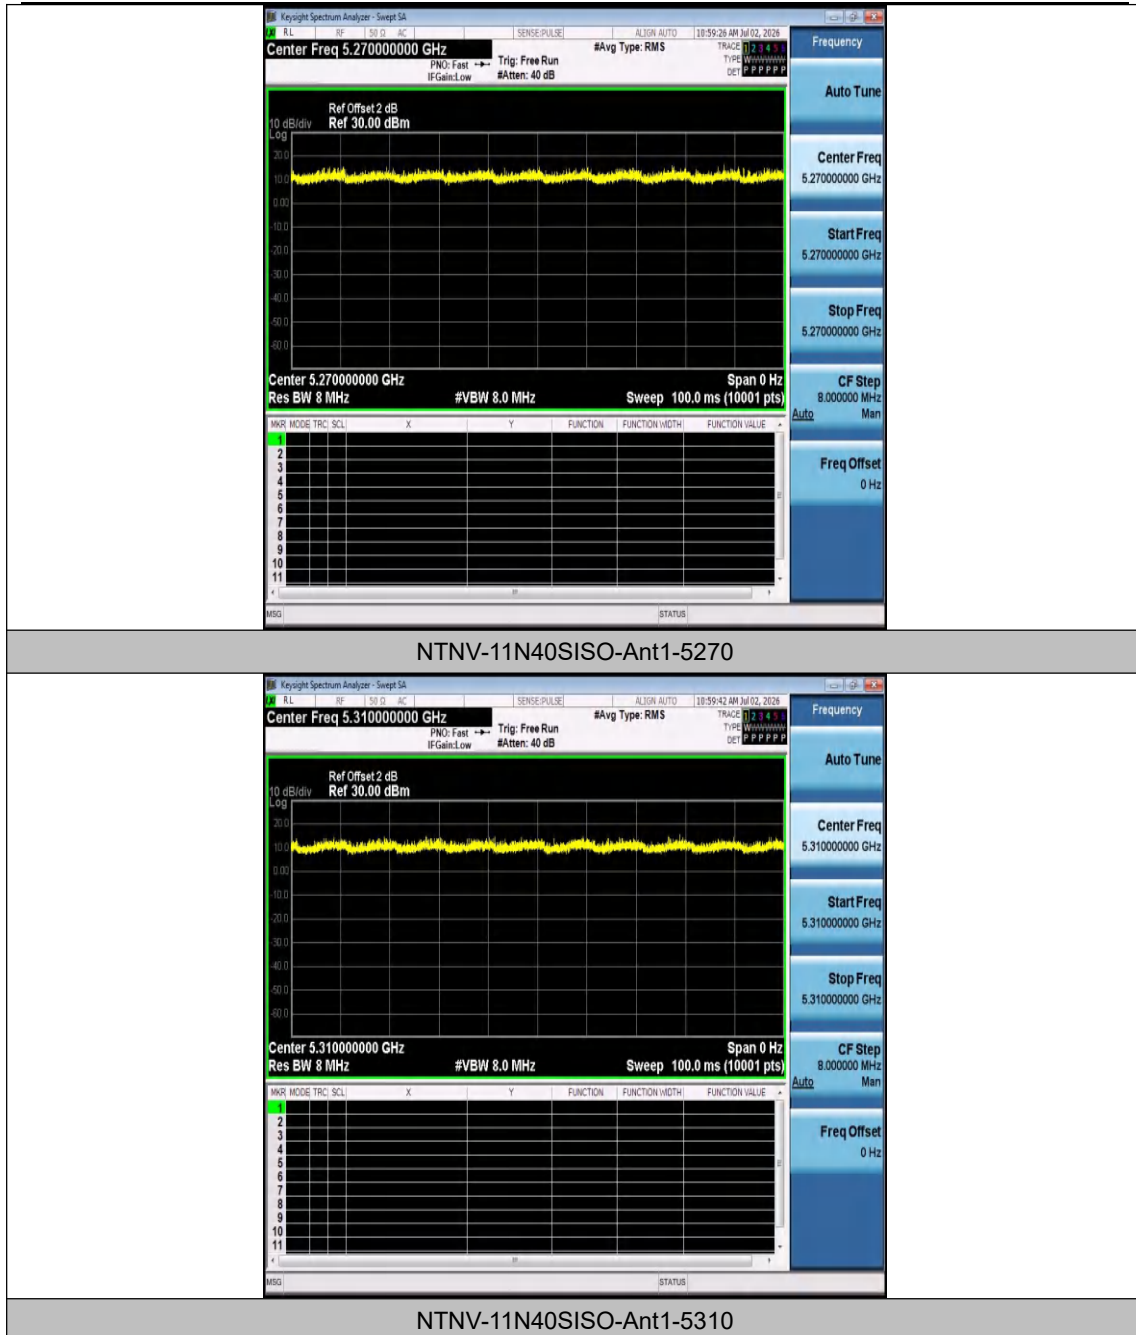

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

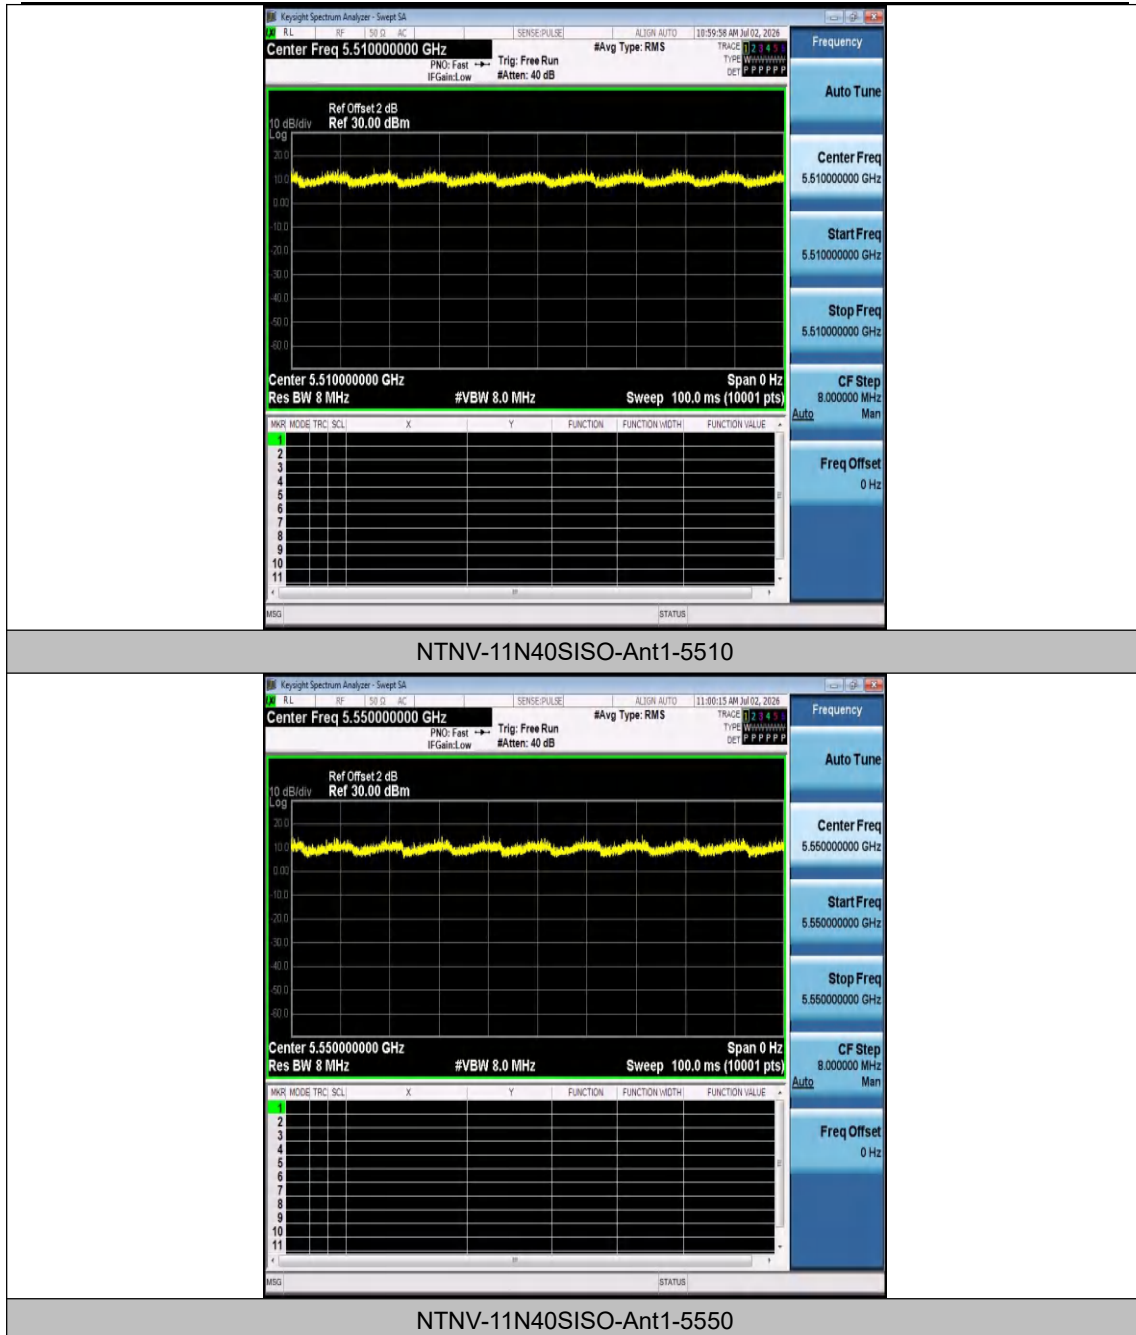

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

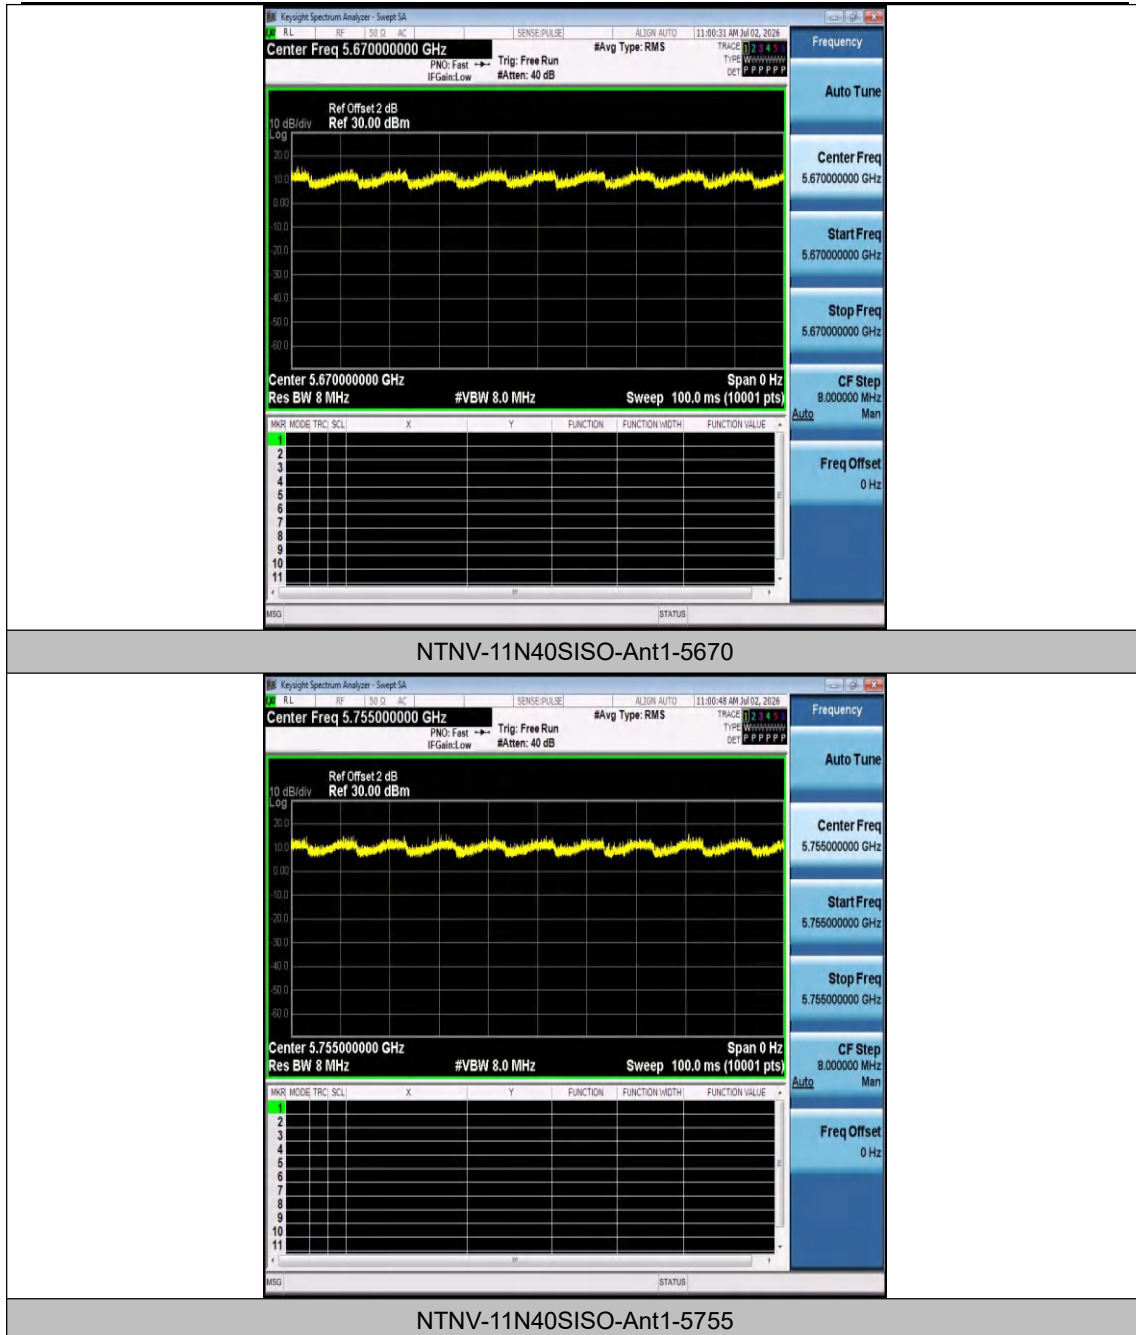

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

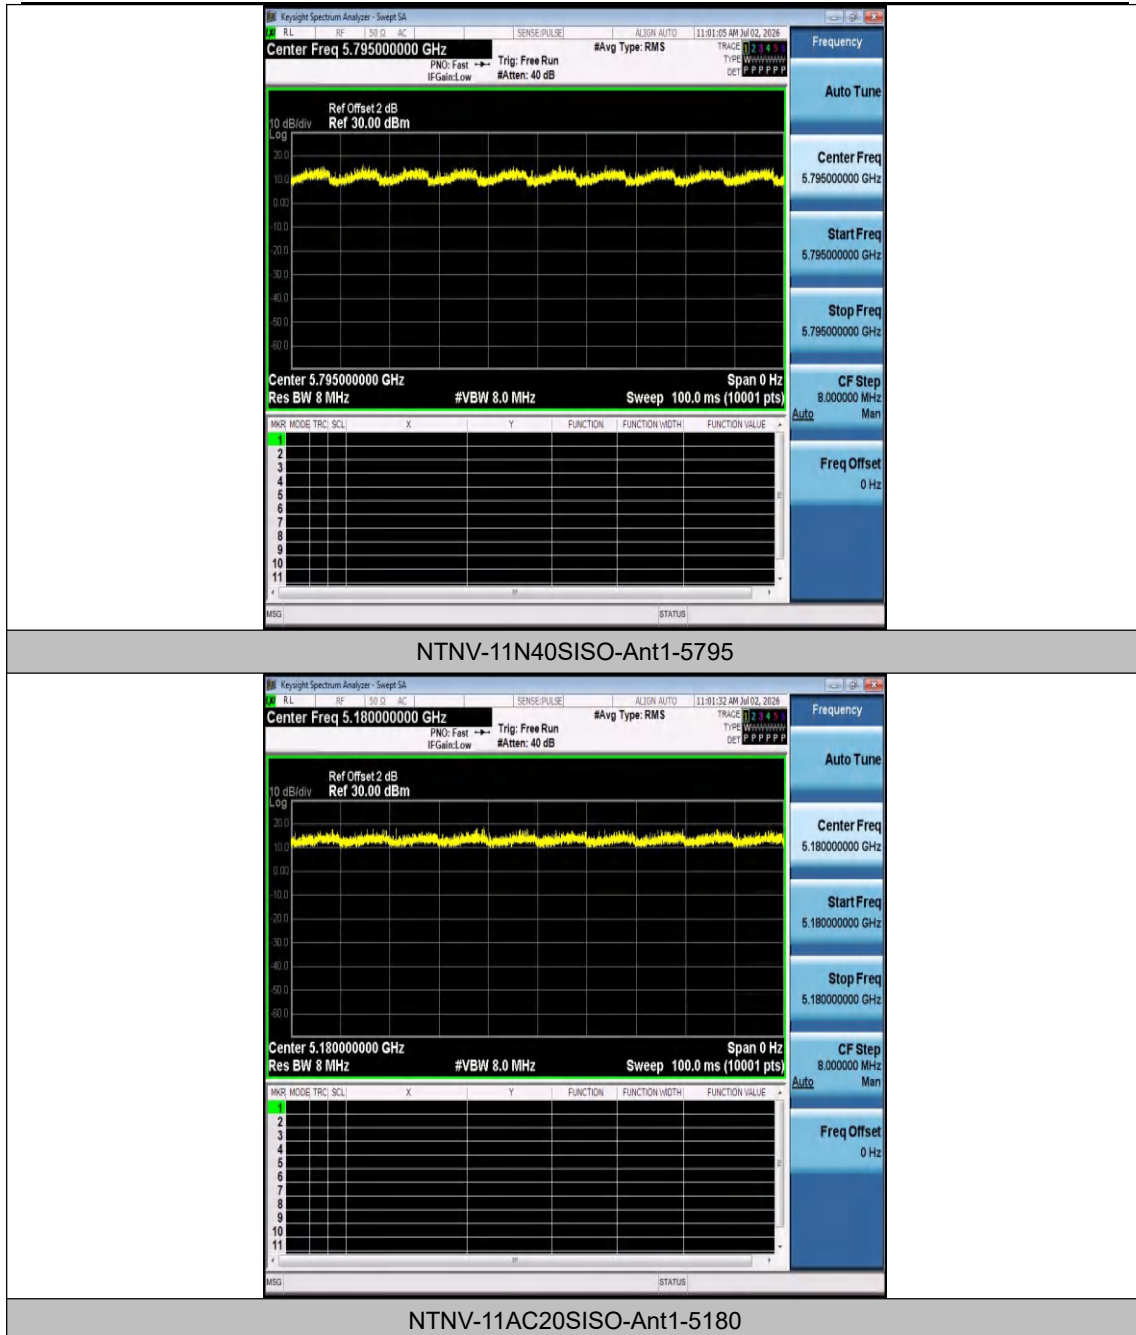

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

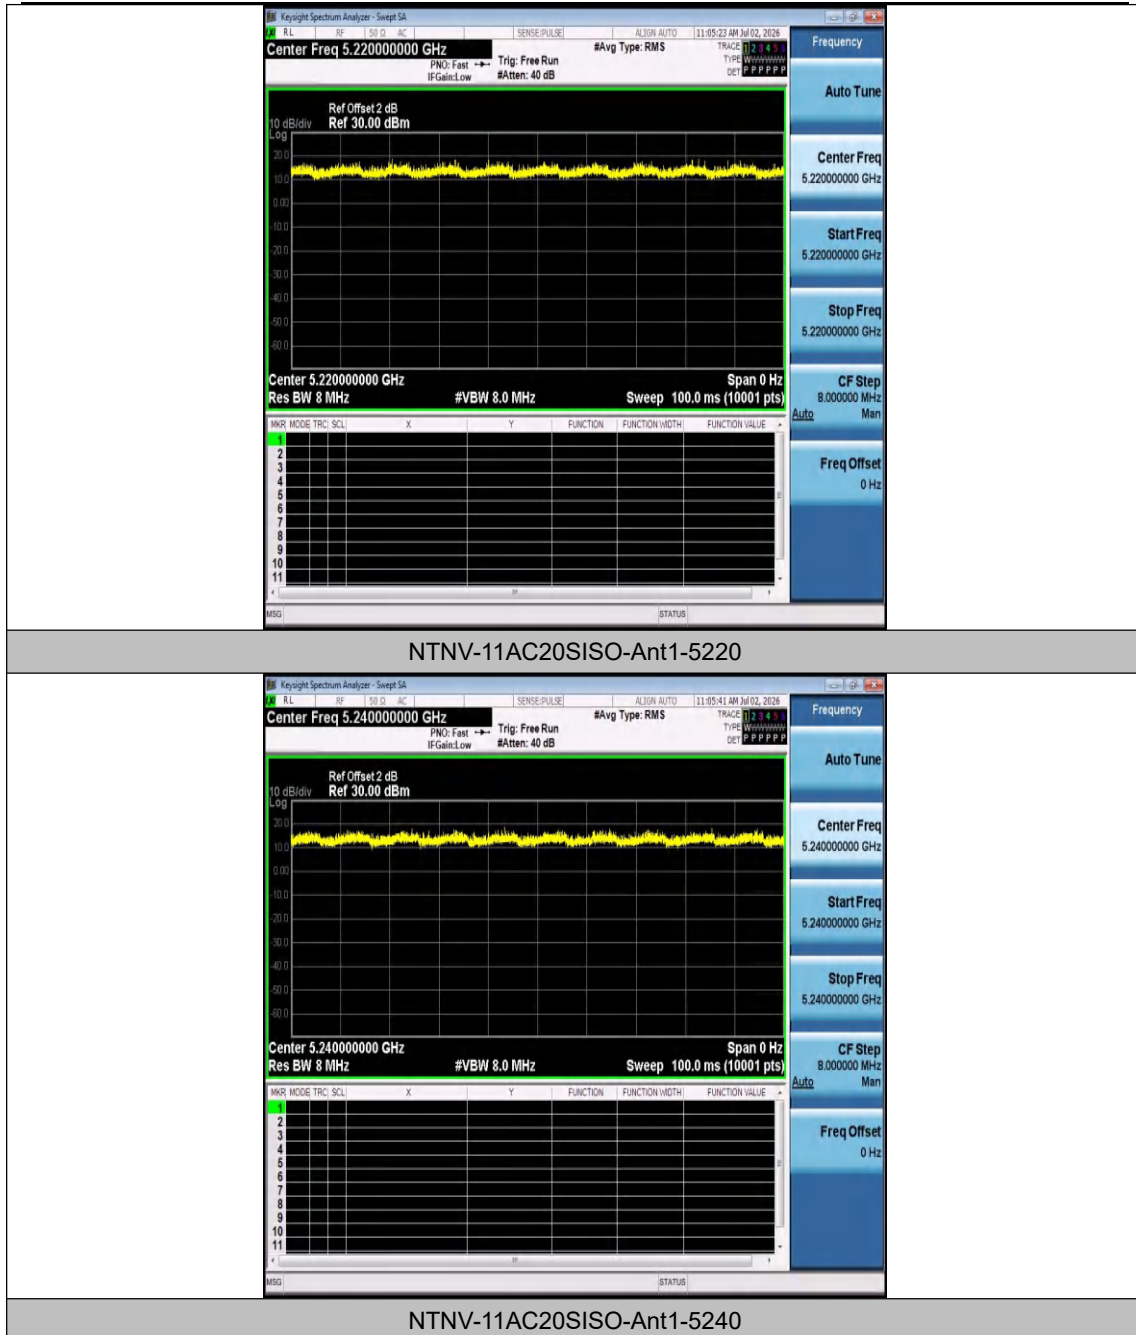


### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

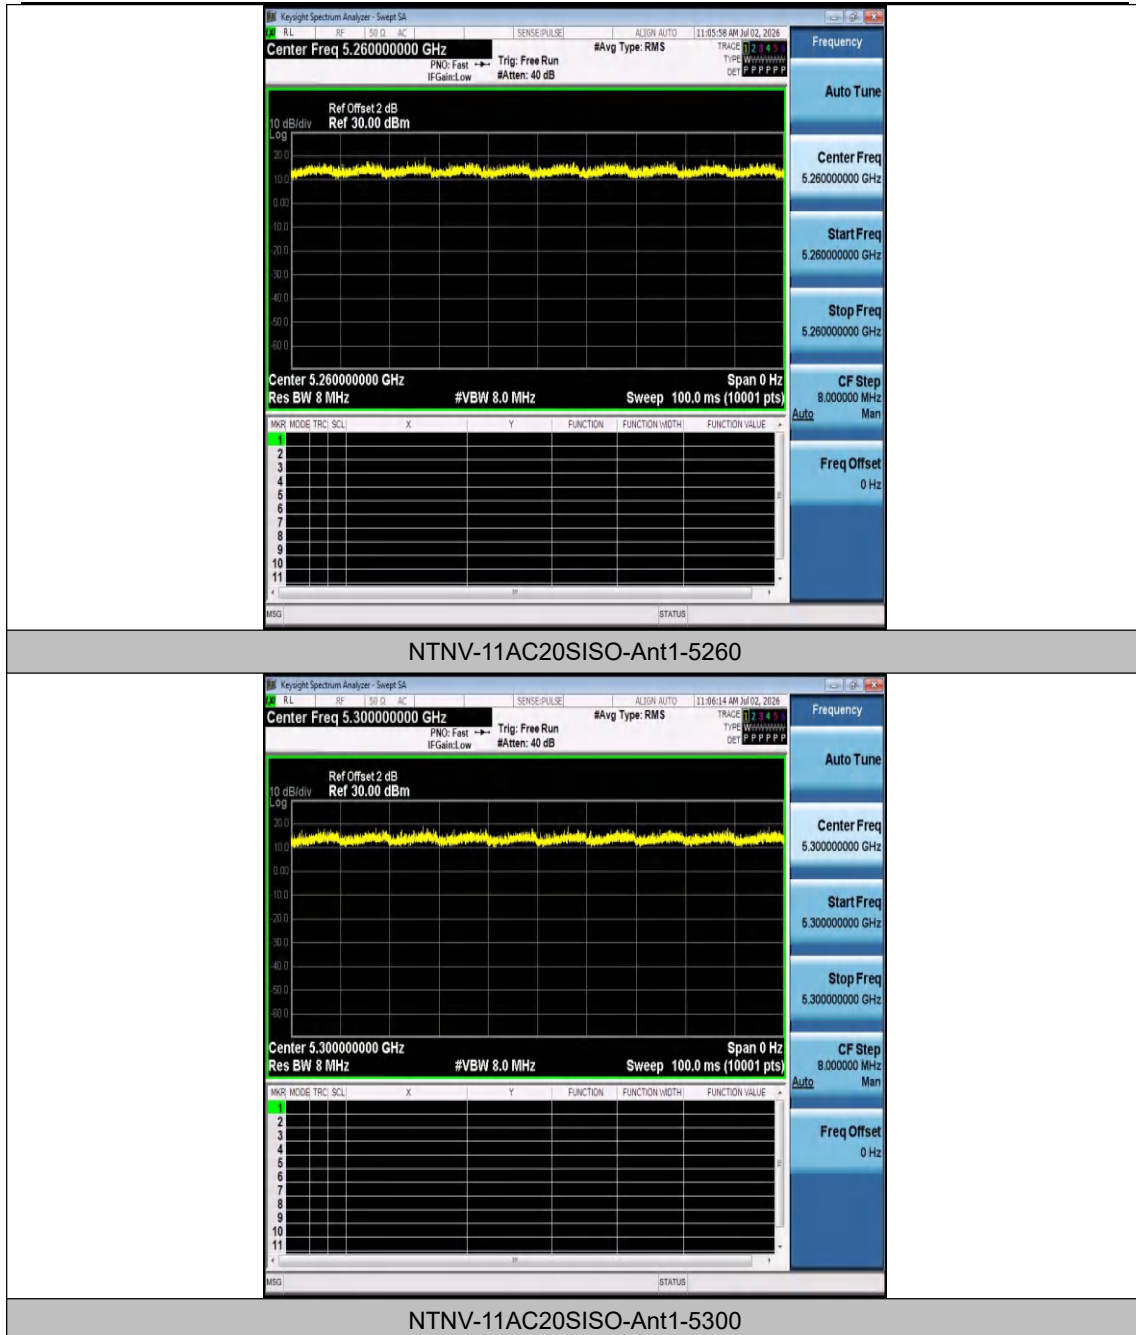


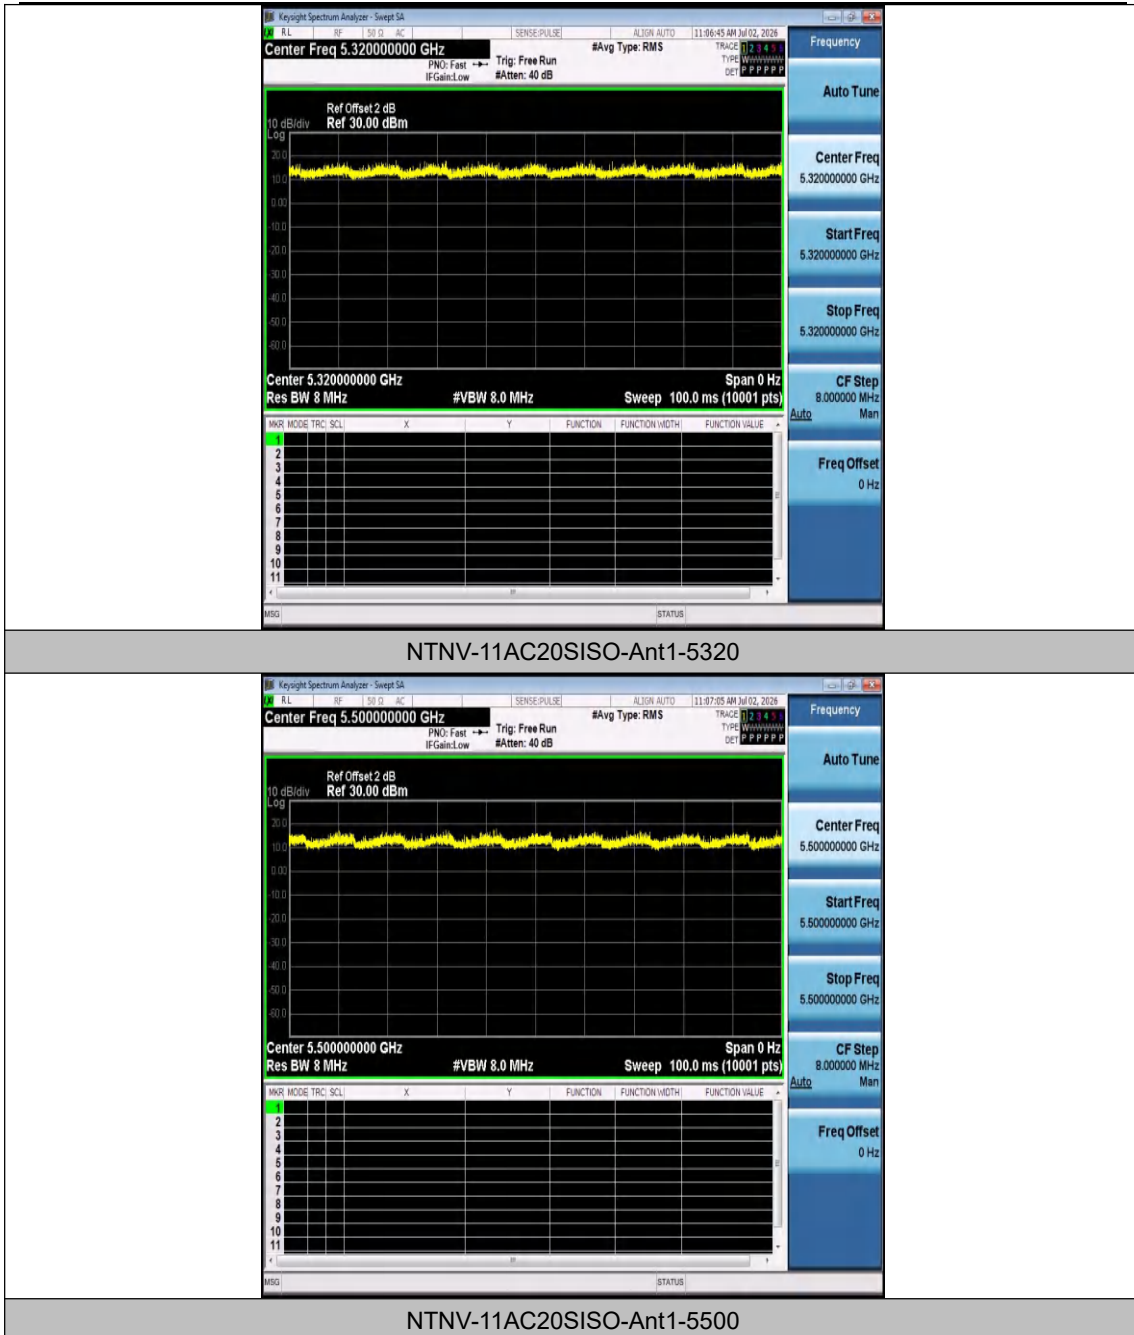

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

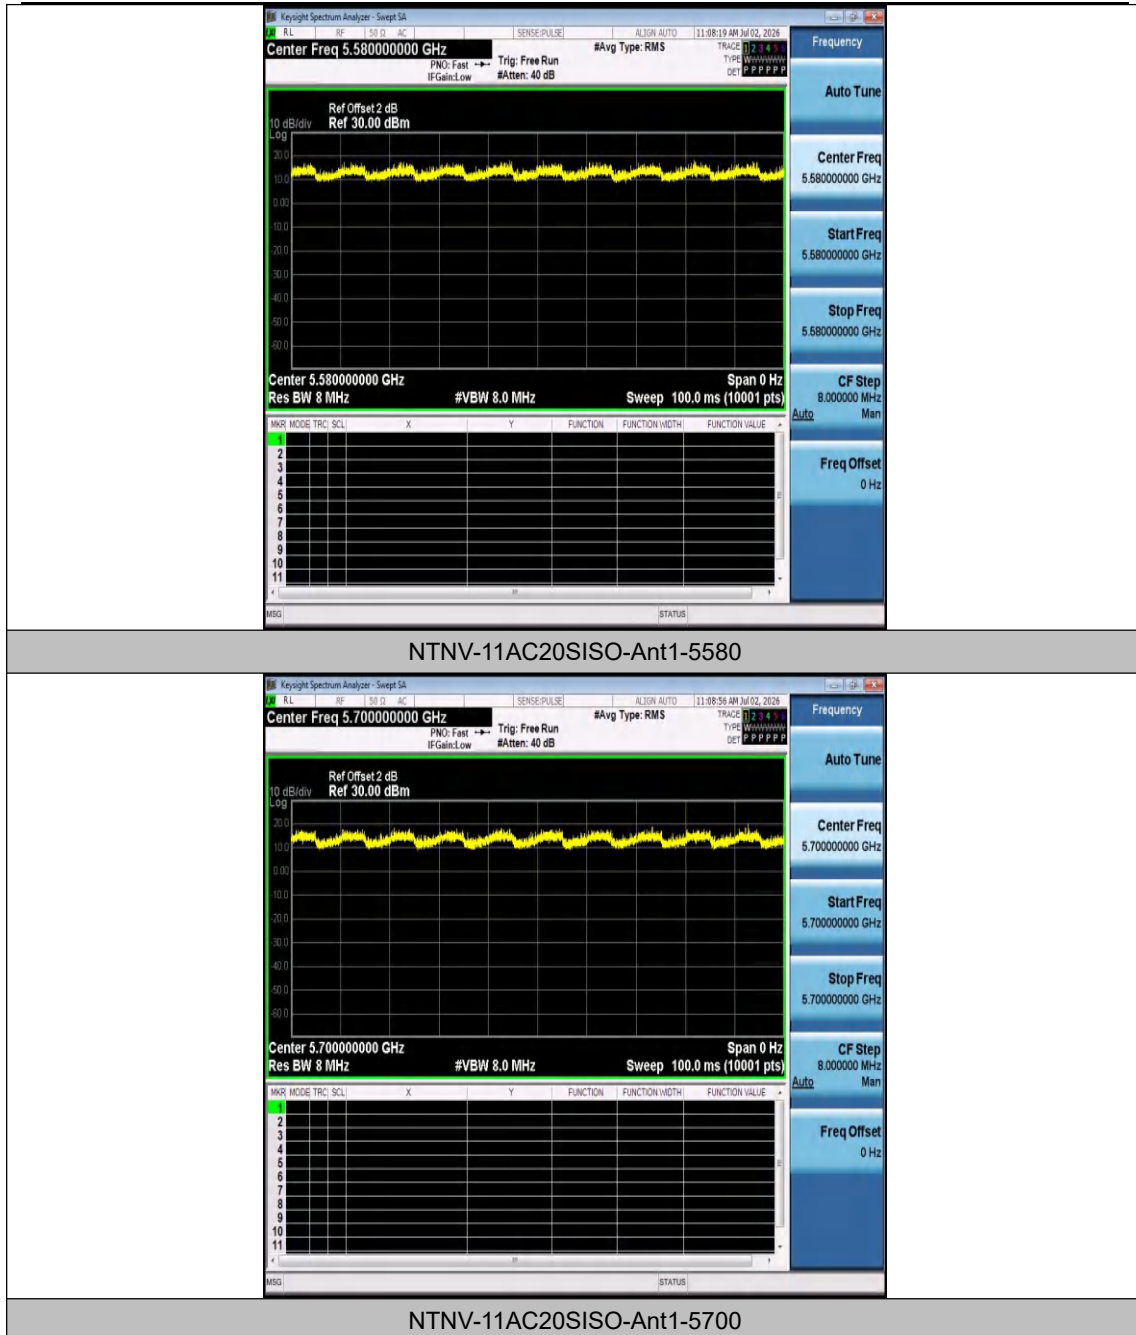

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

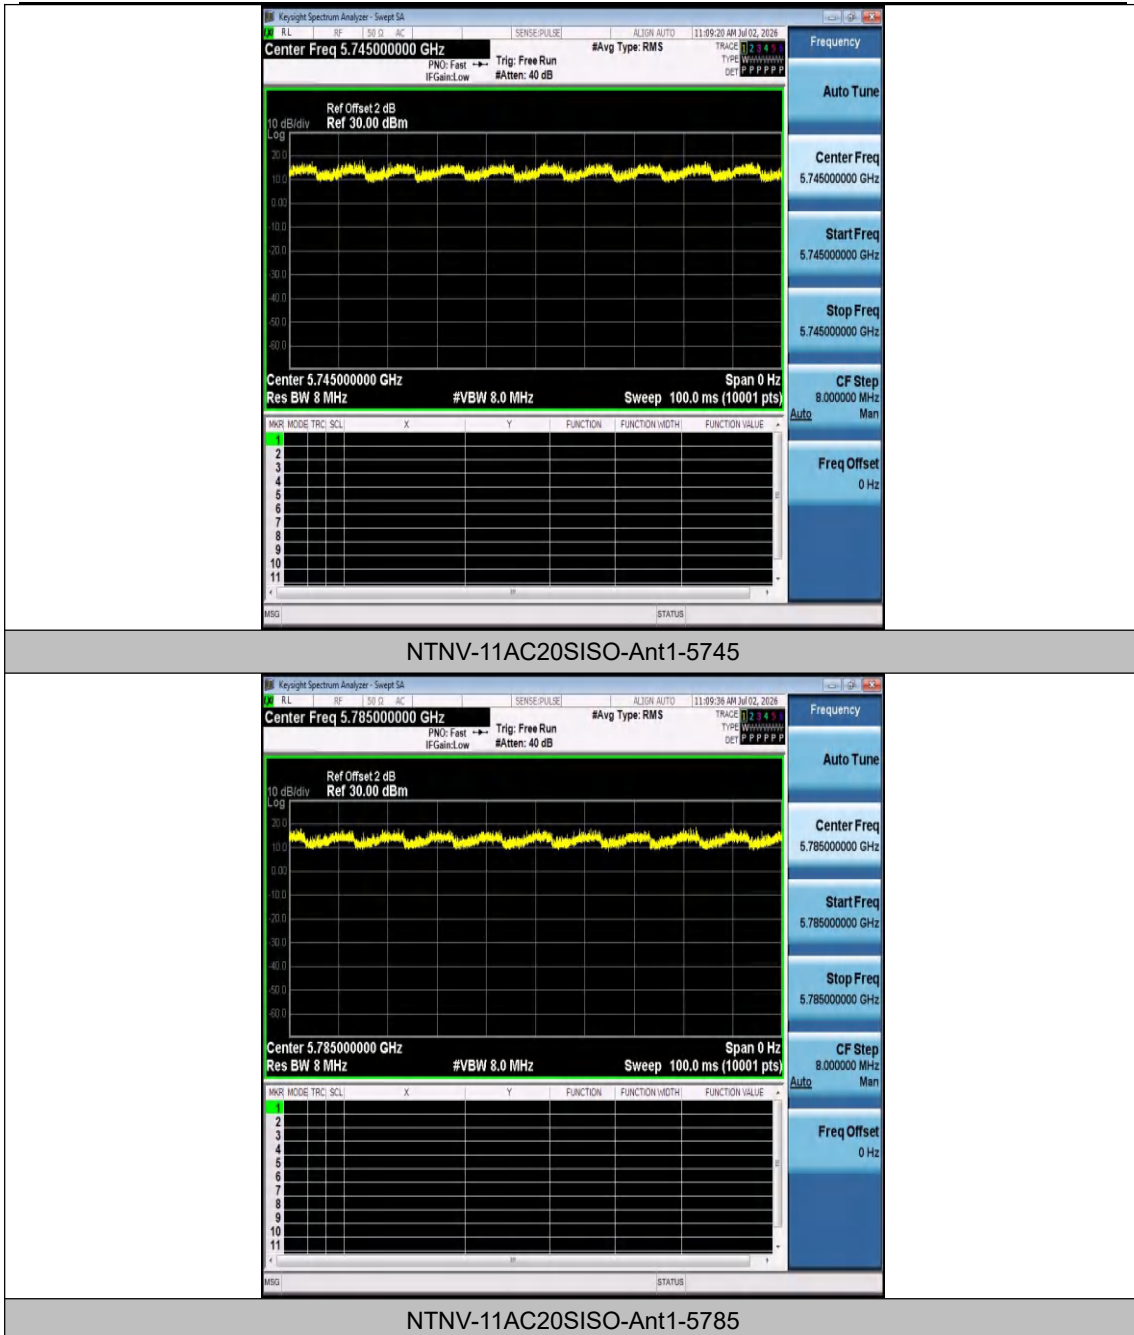


#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

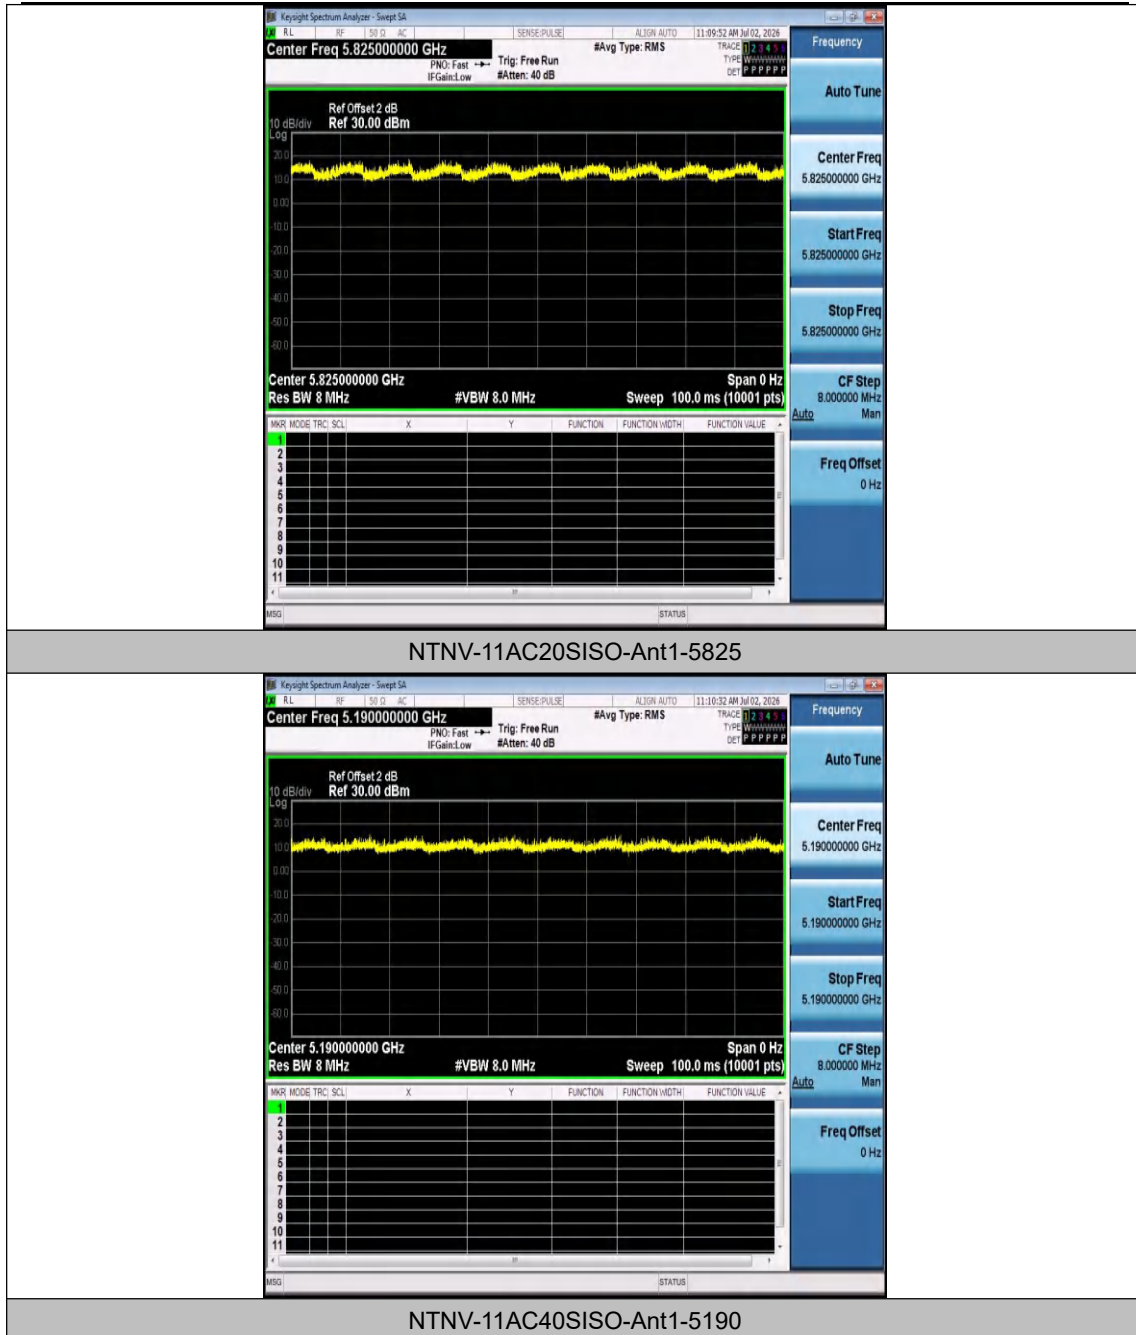


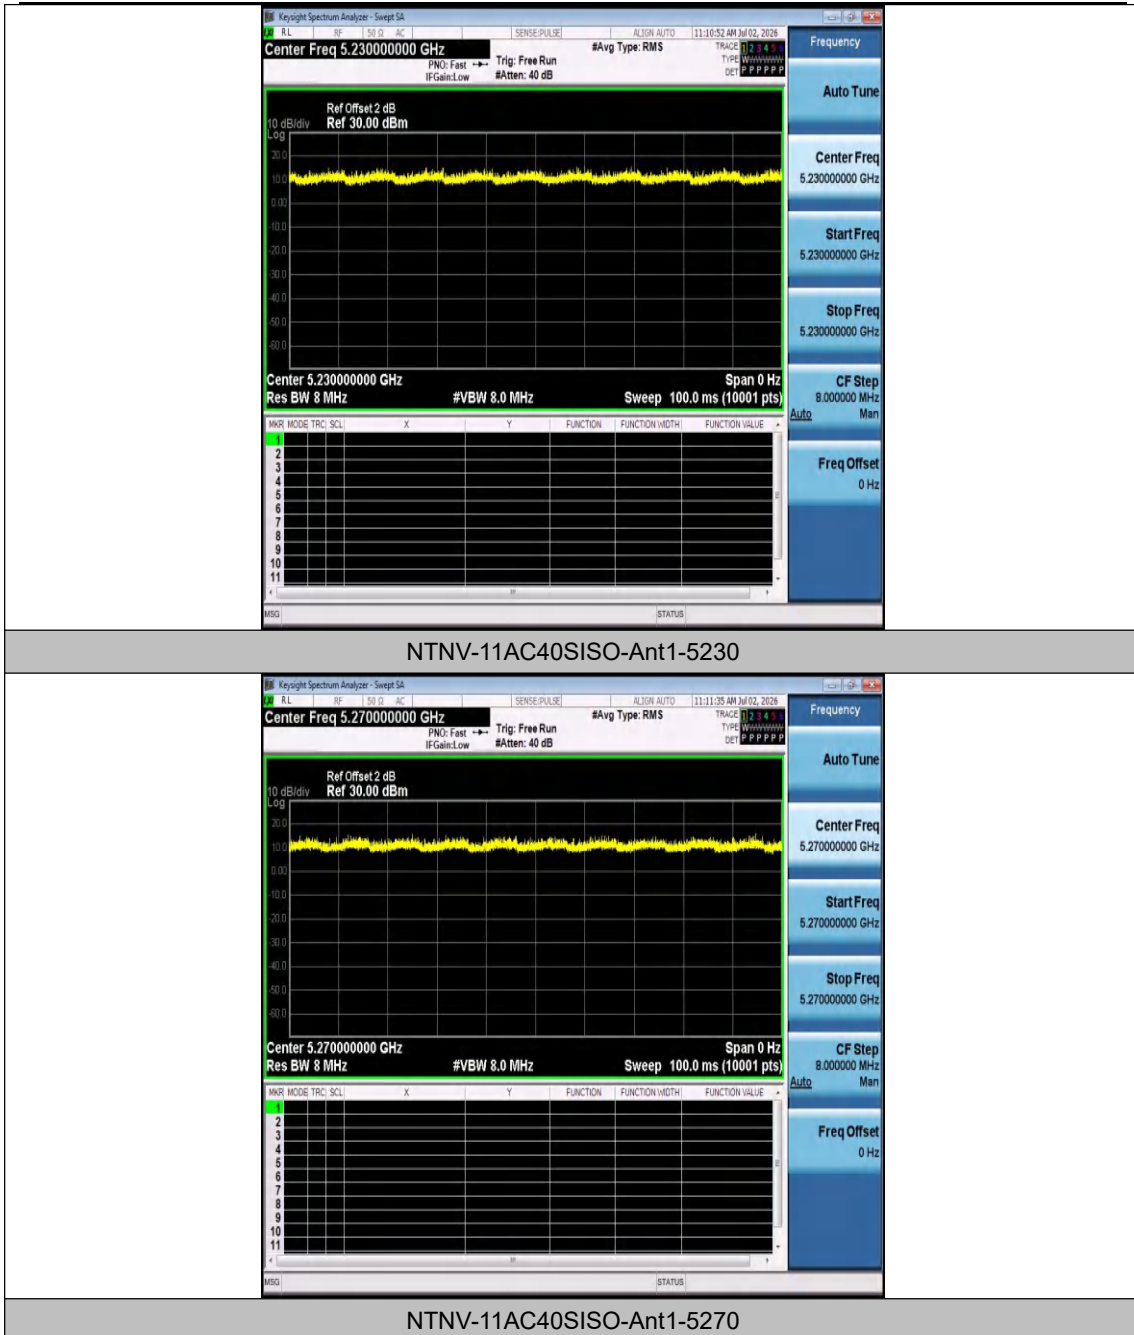



#### Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

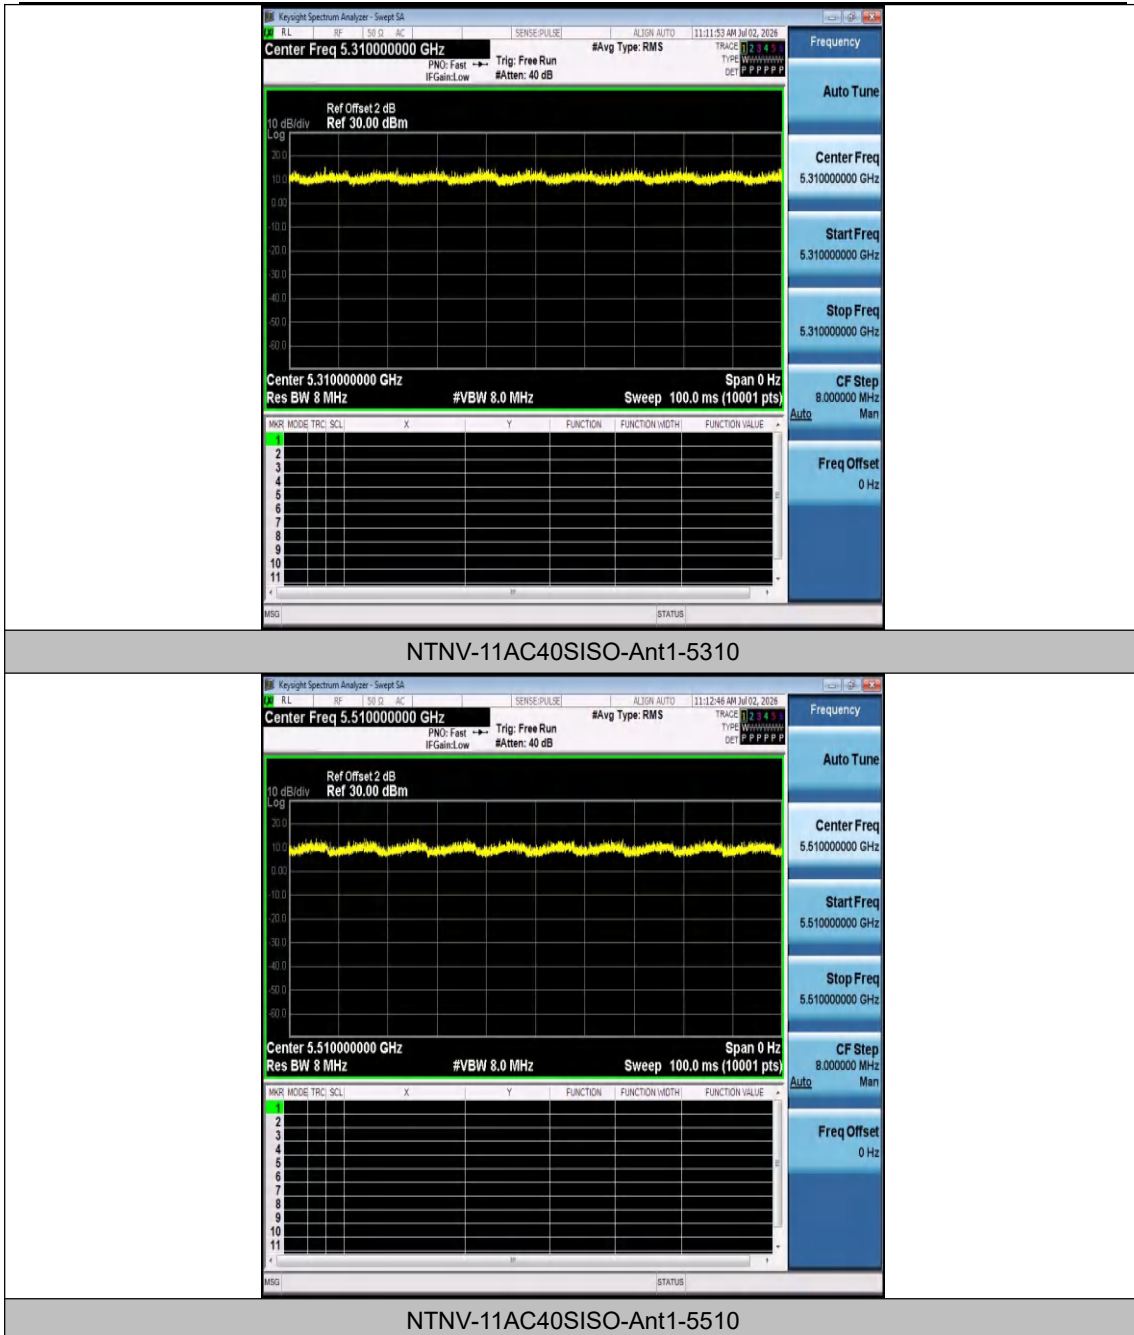

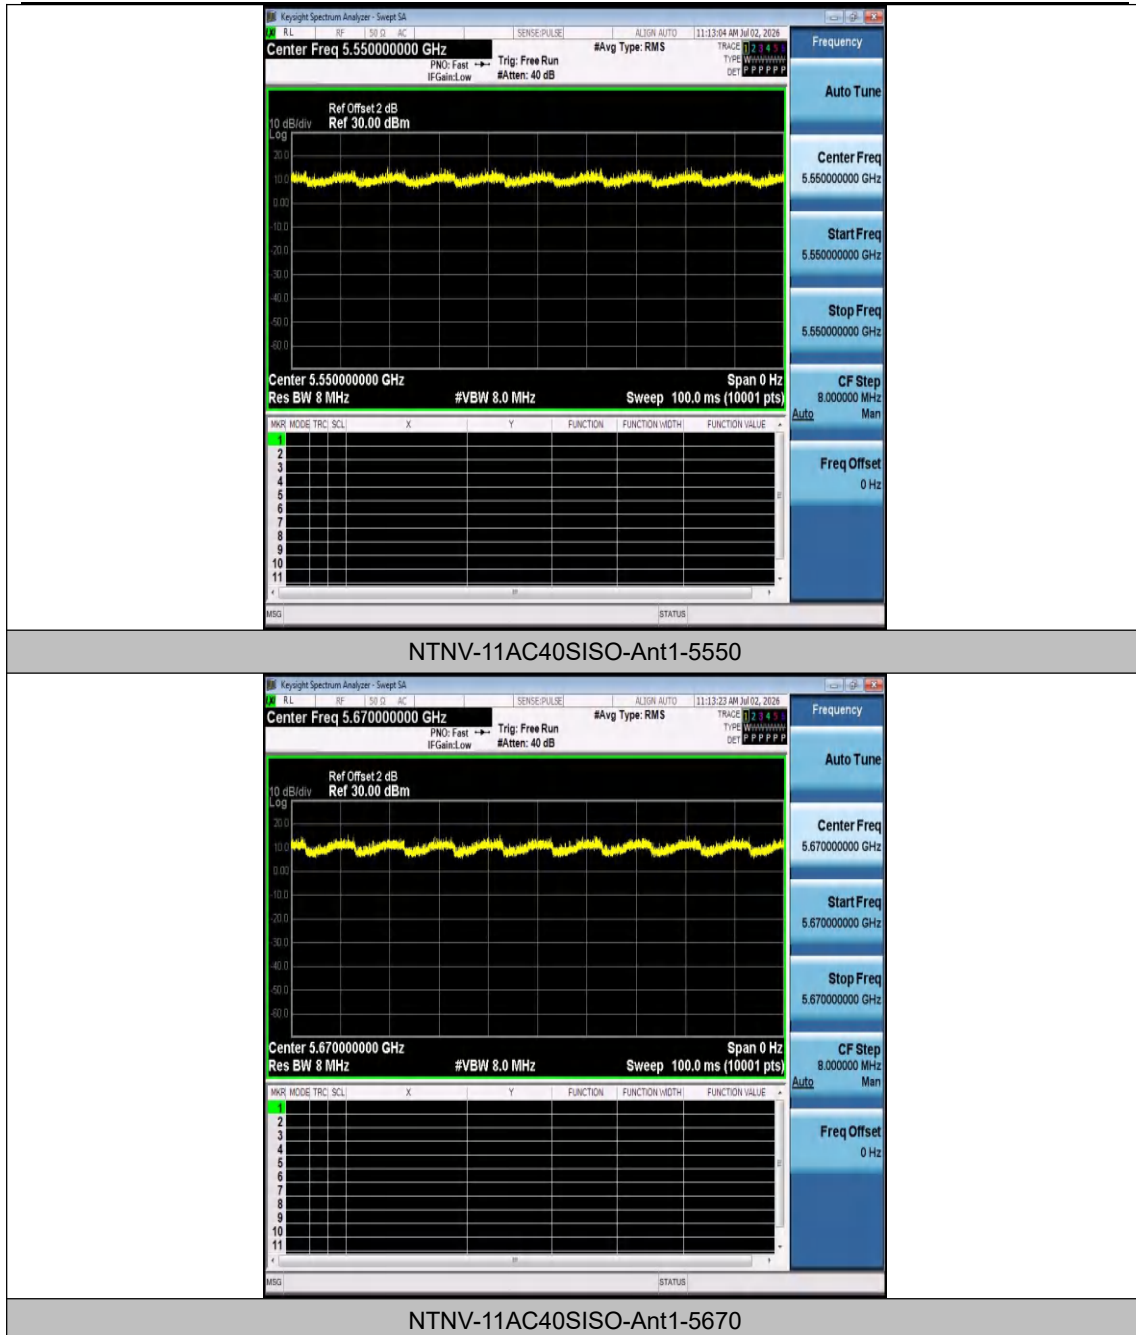

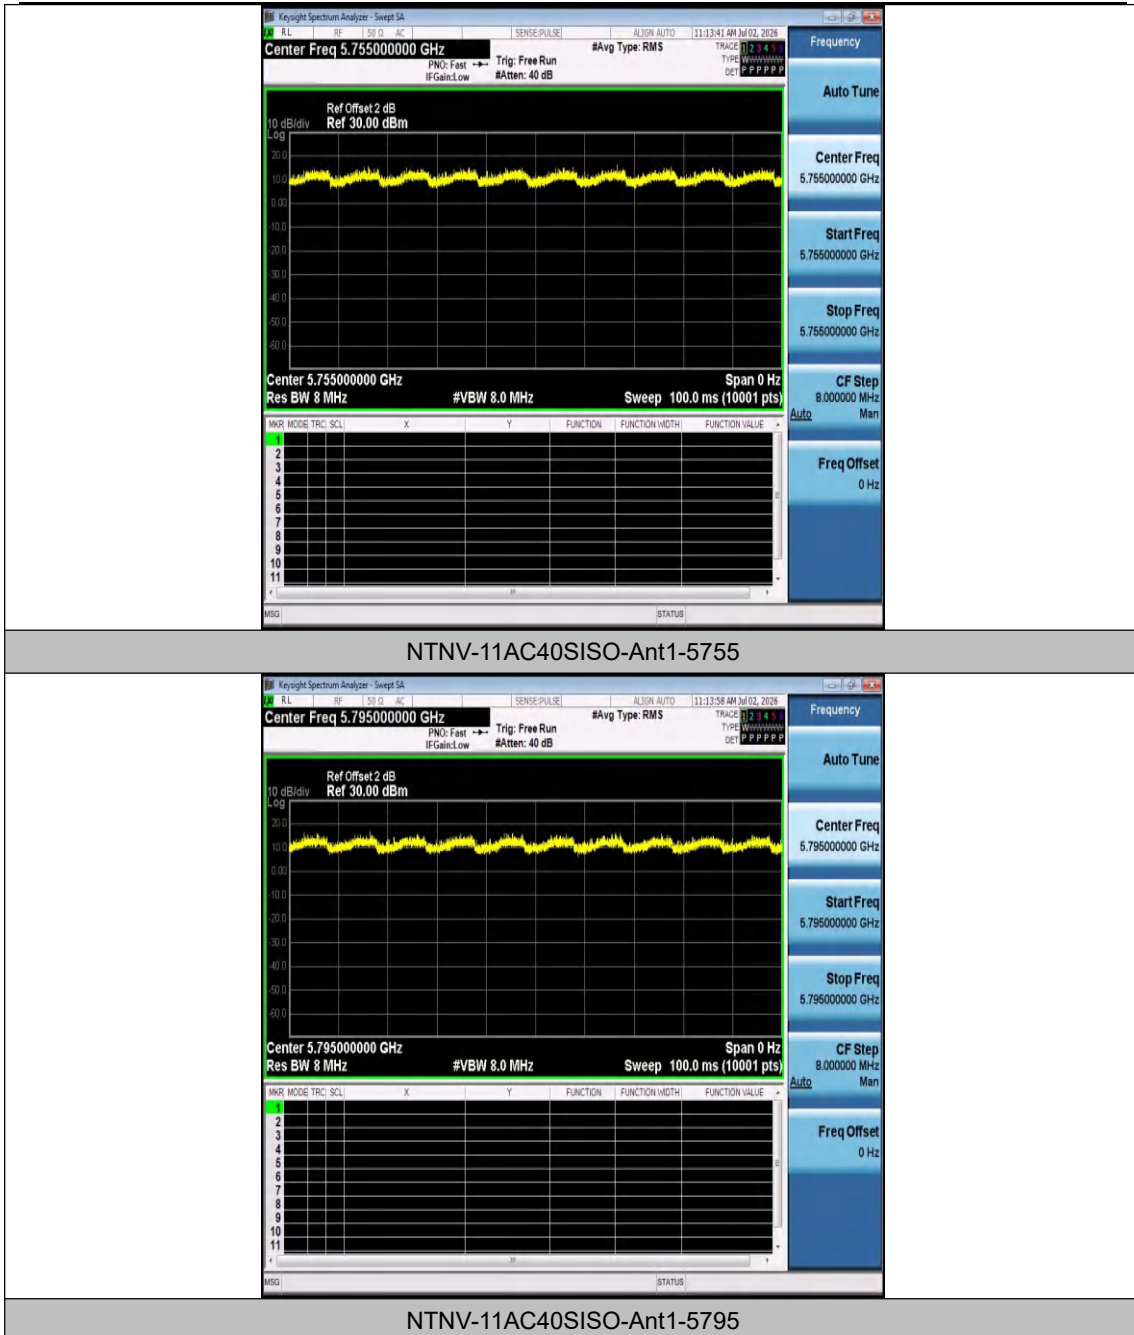


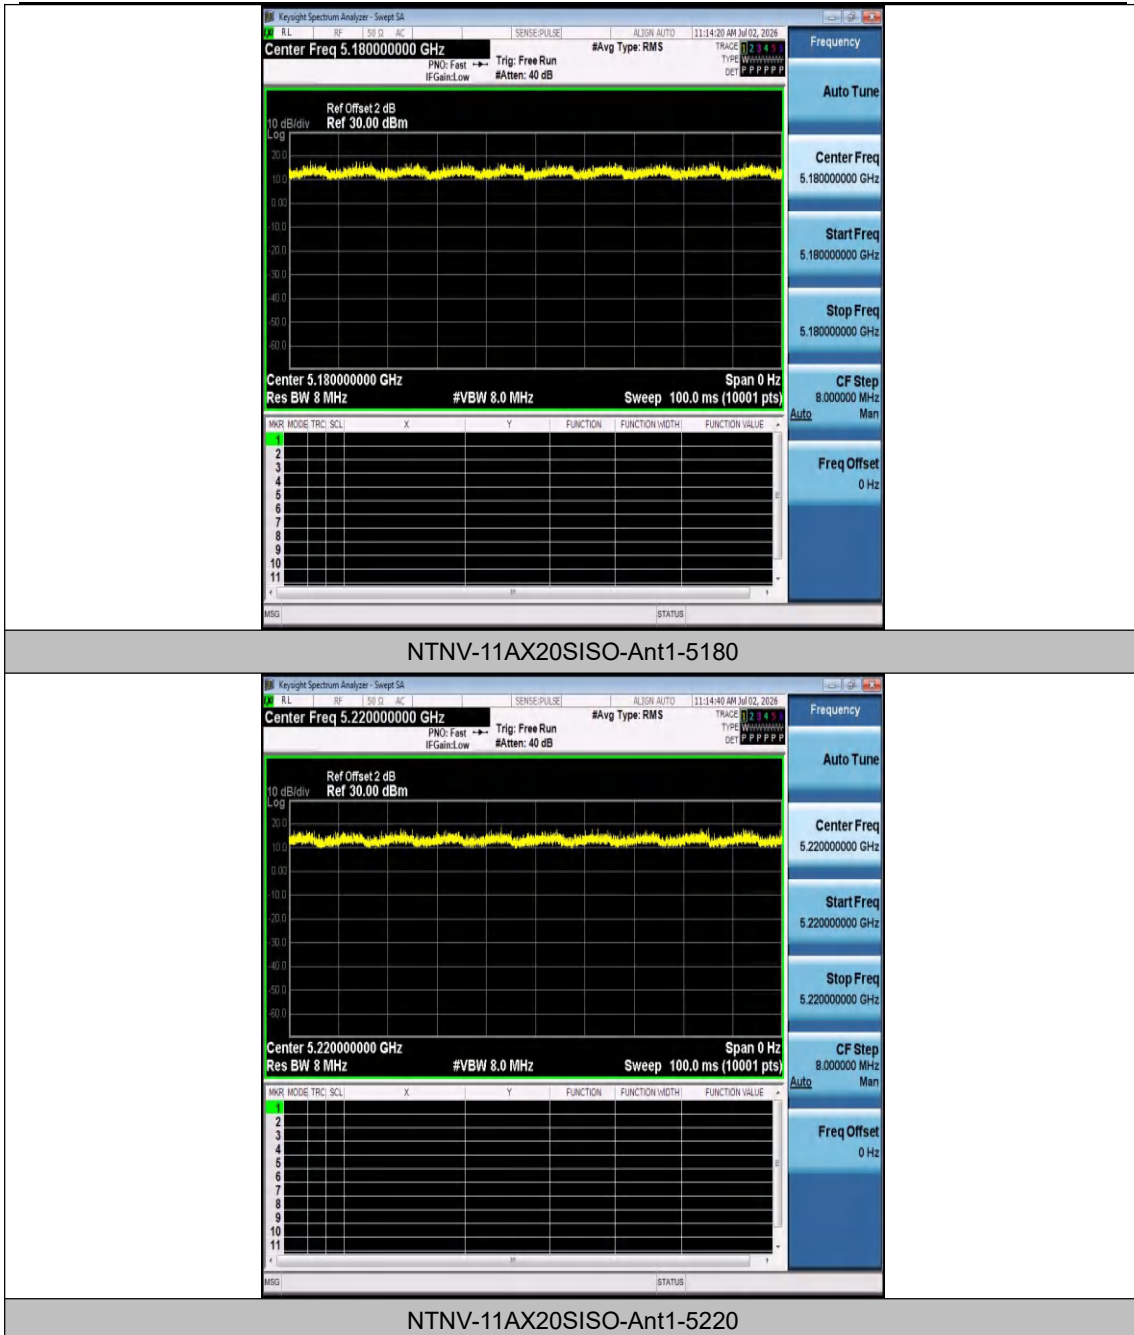

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

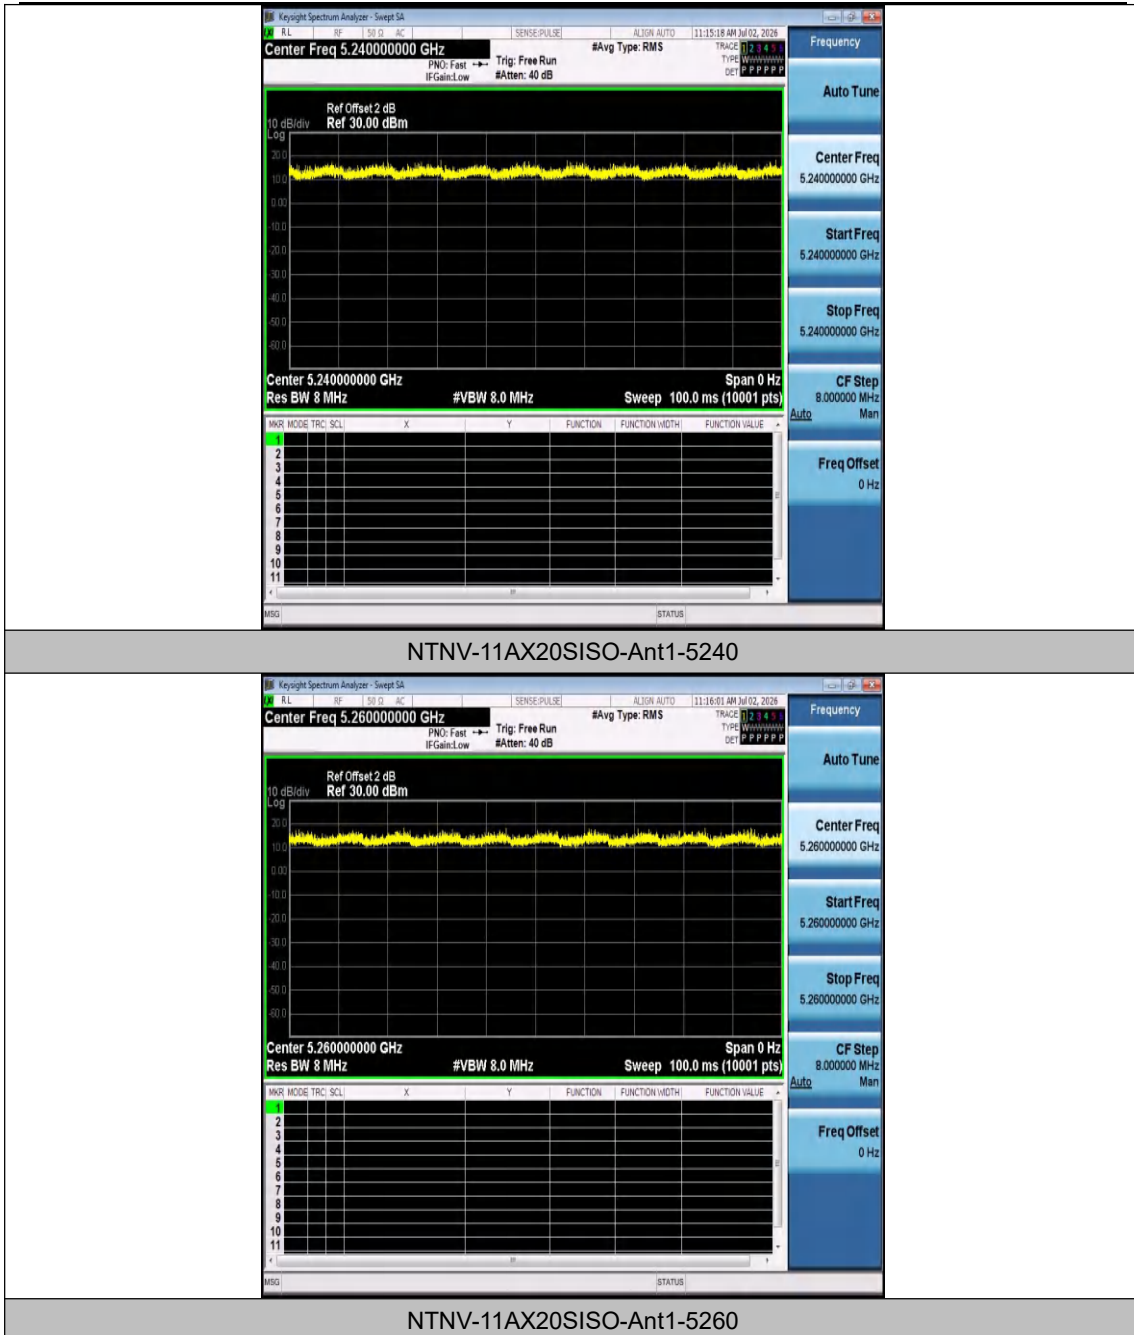

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

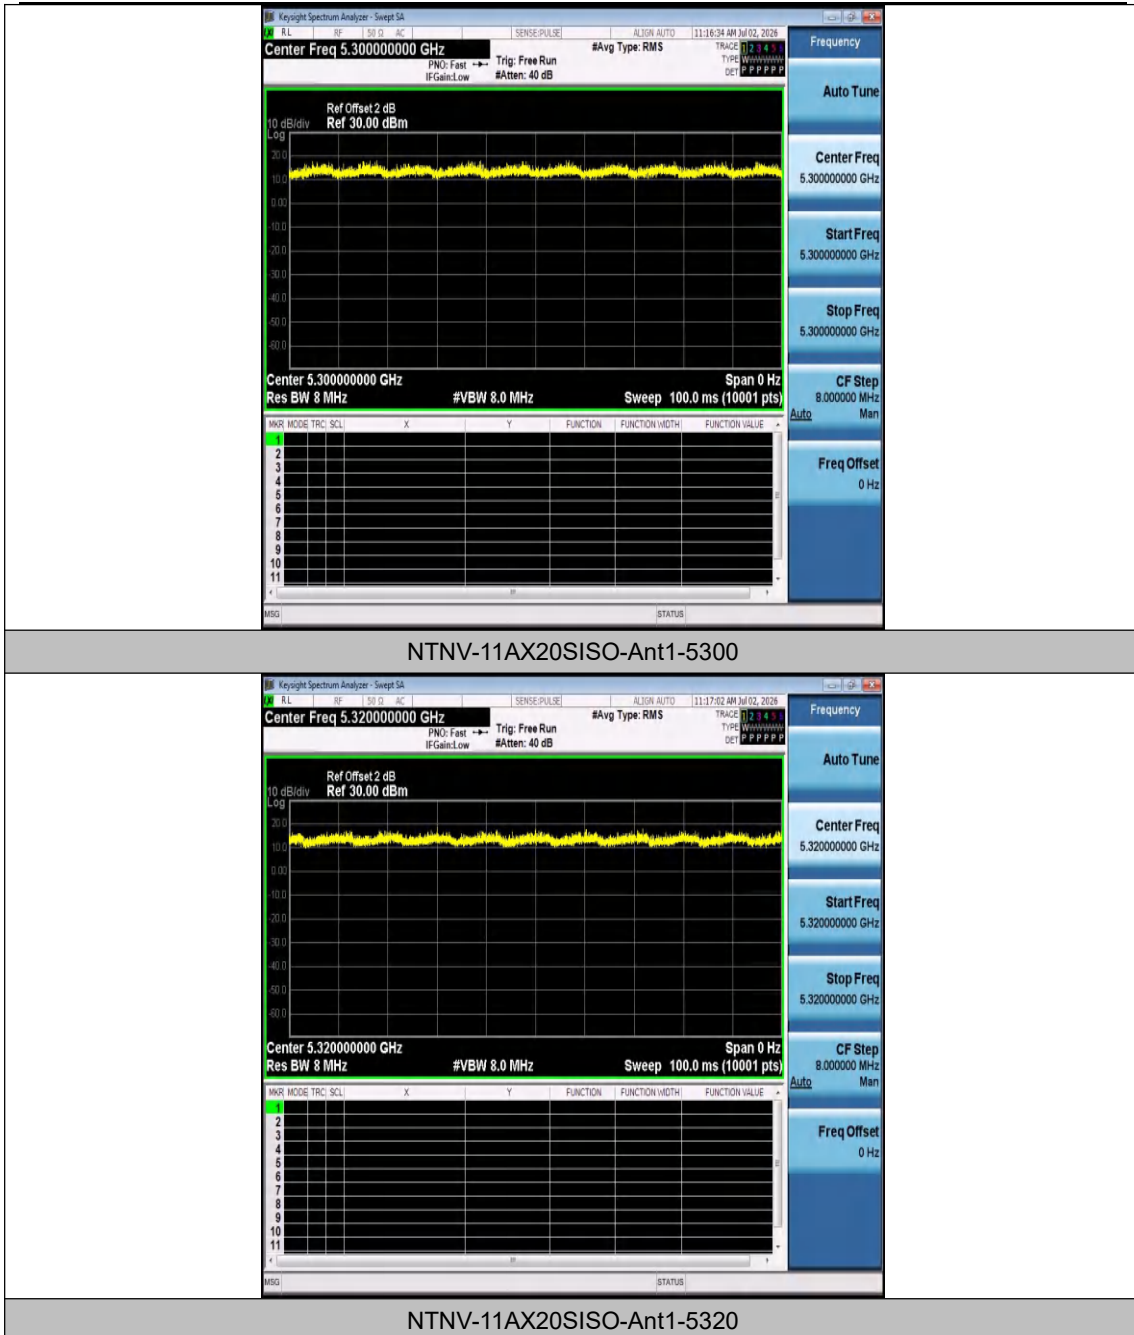



#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

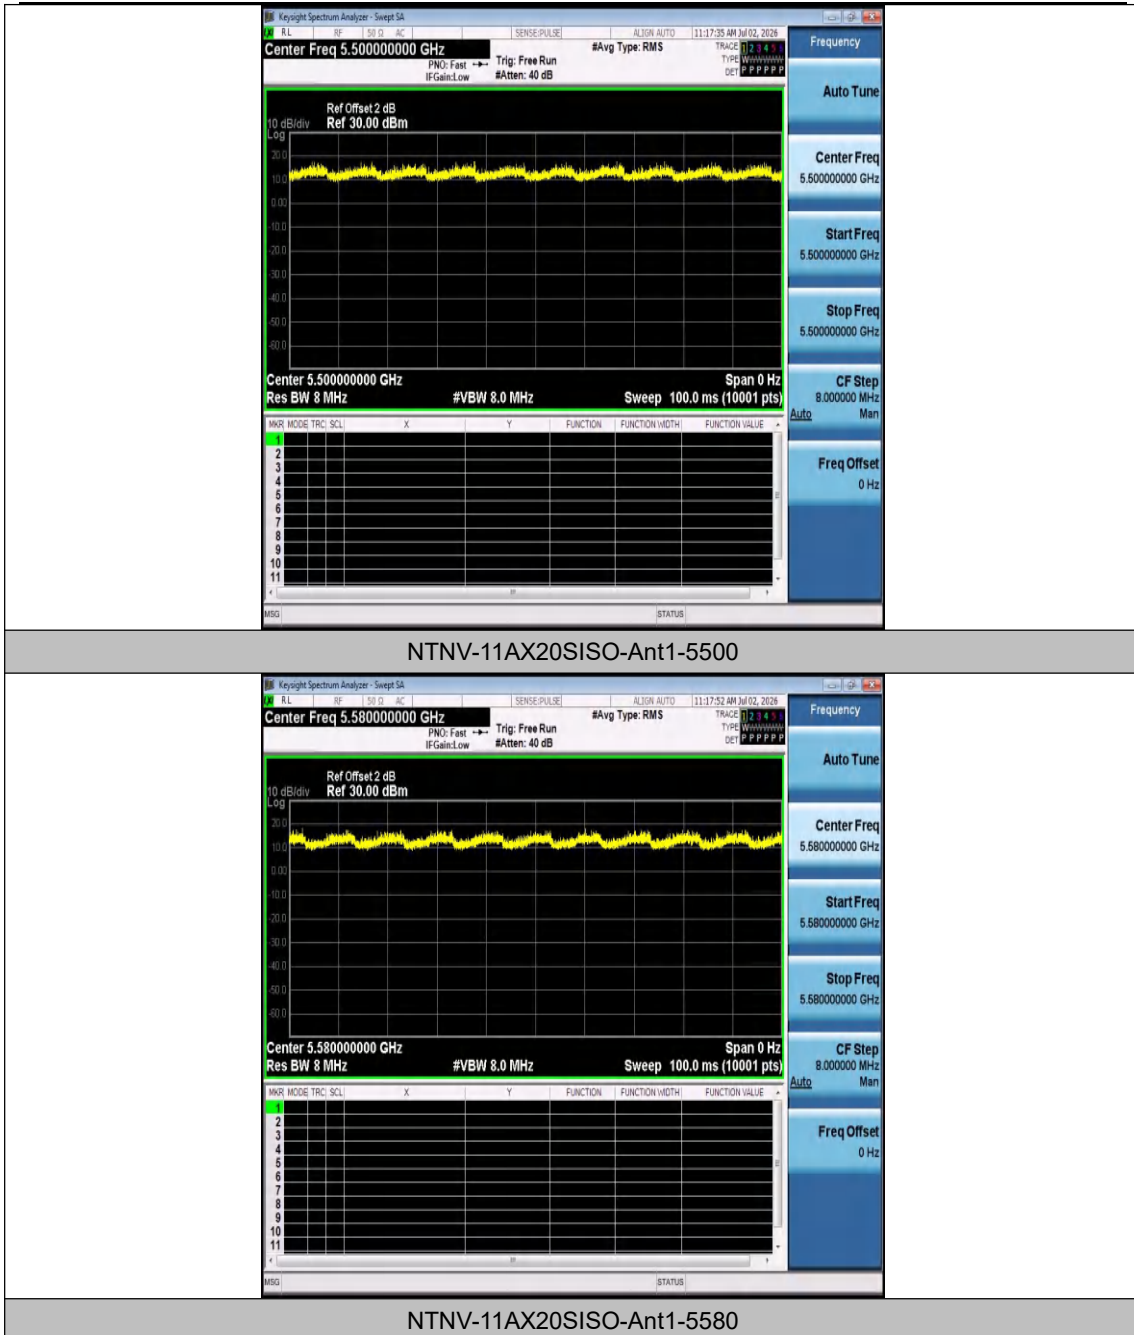

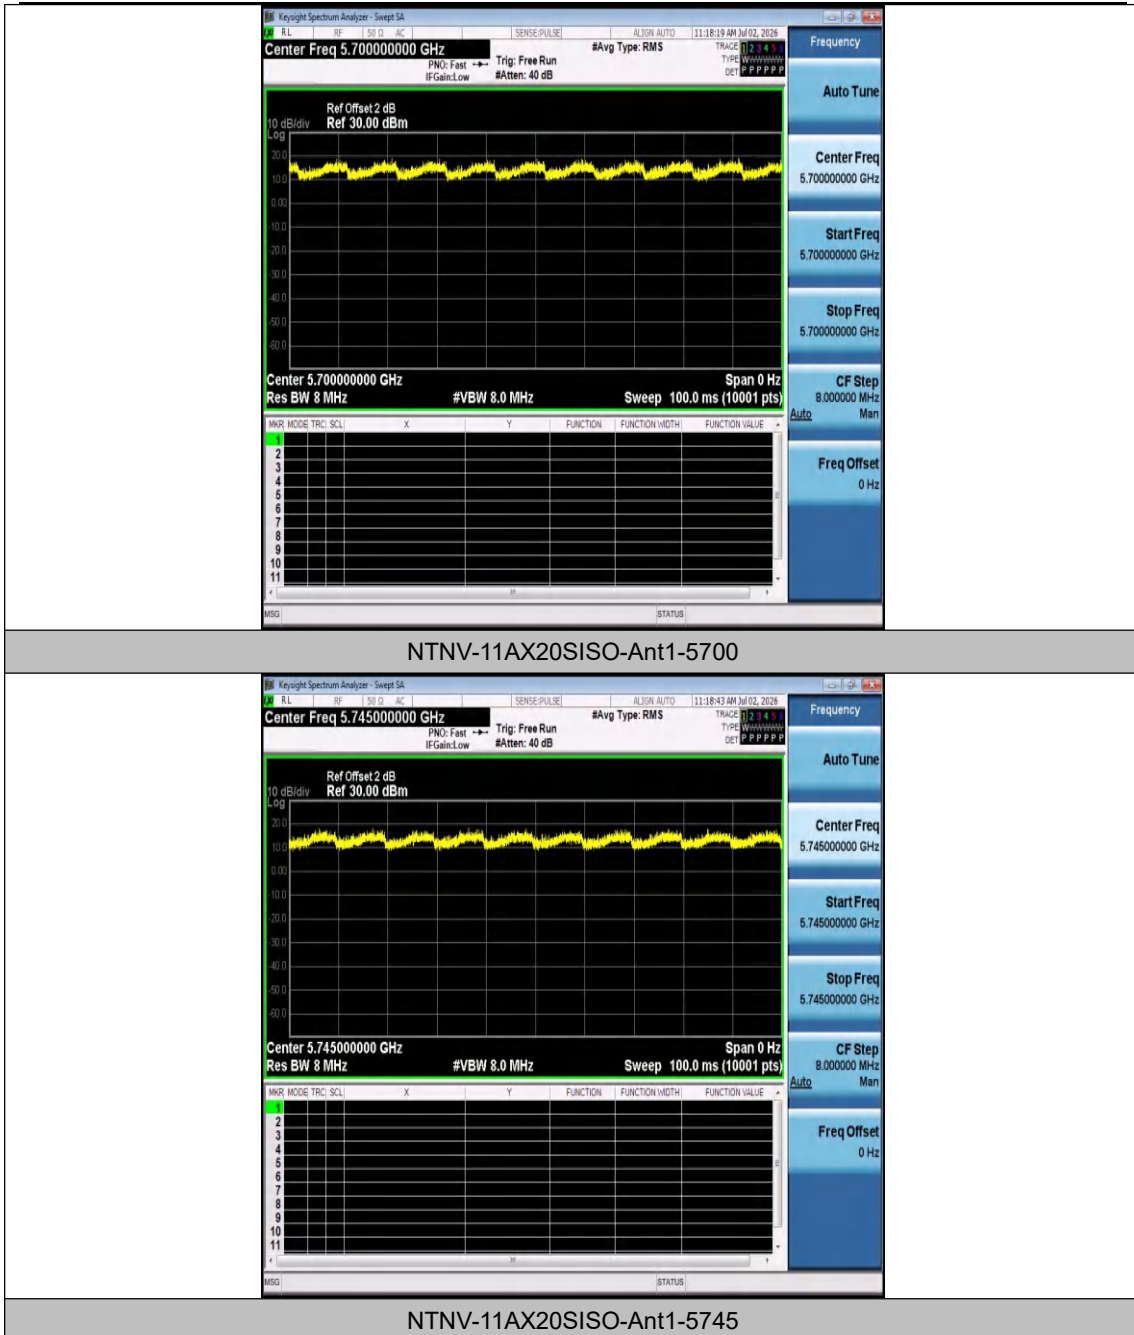


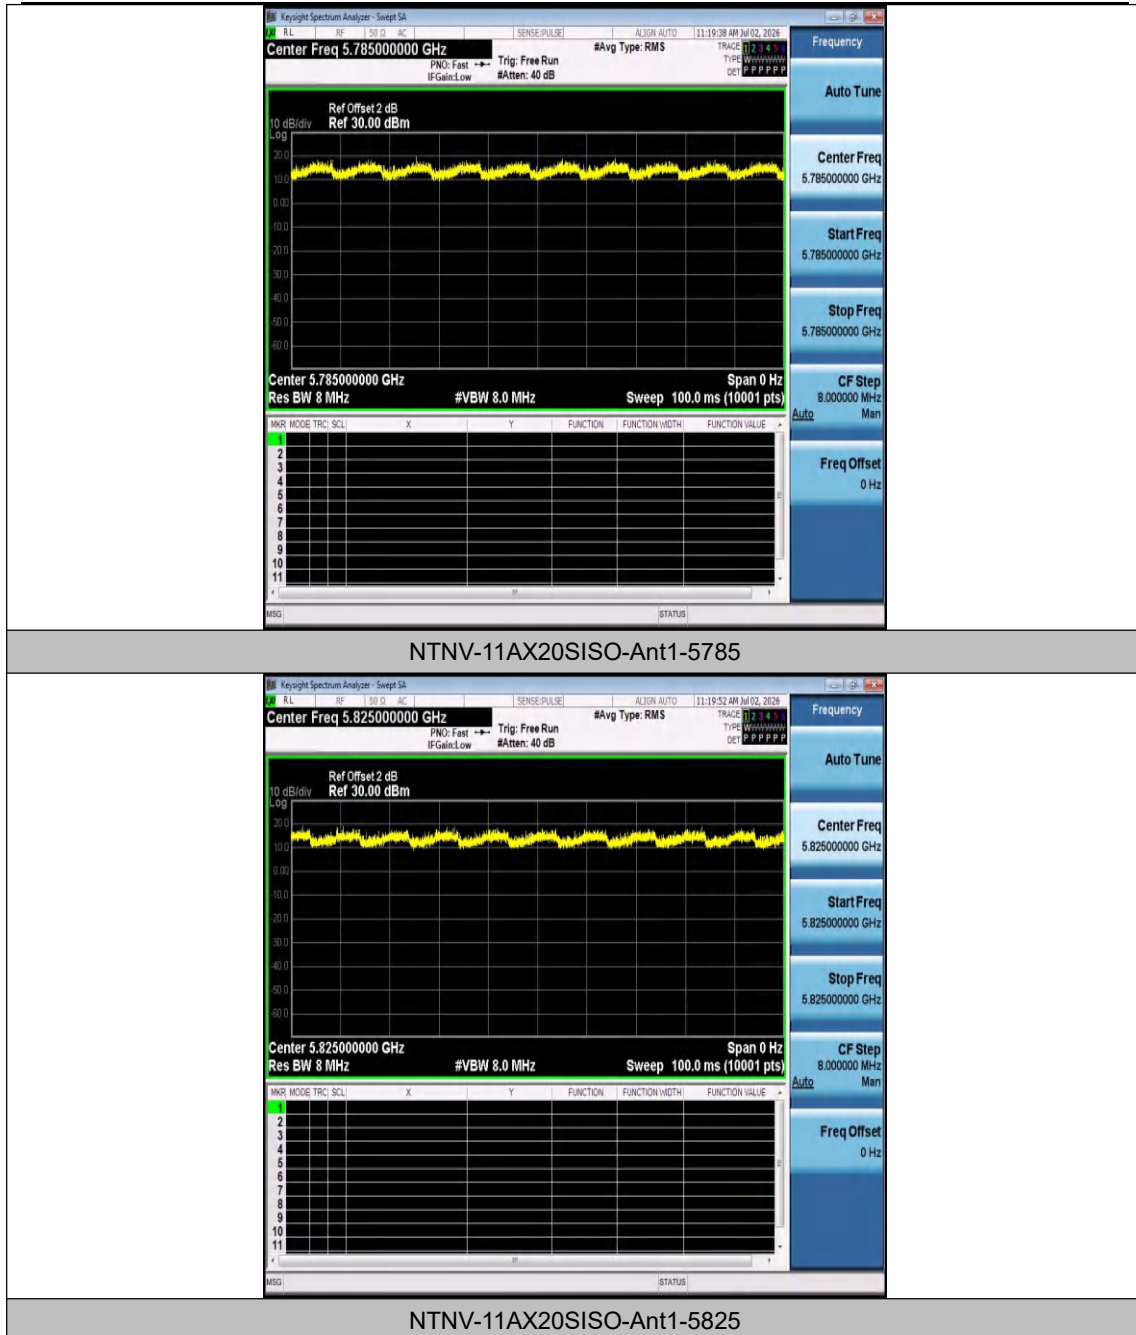


#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

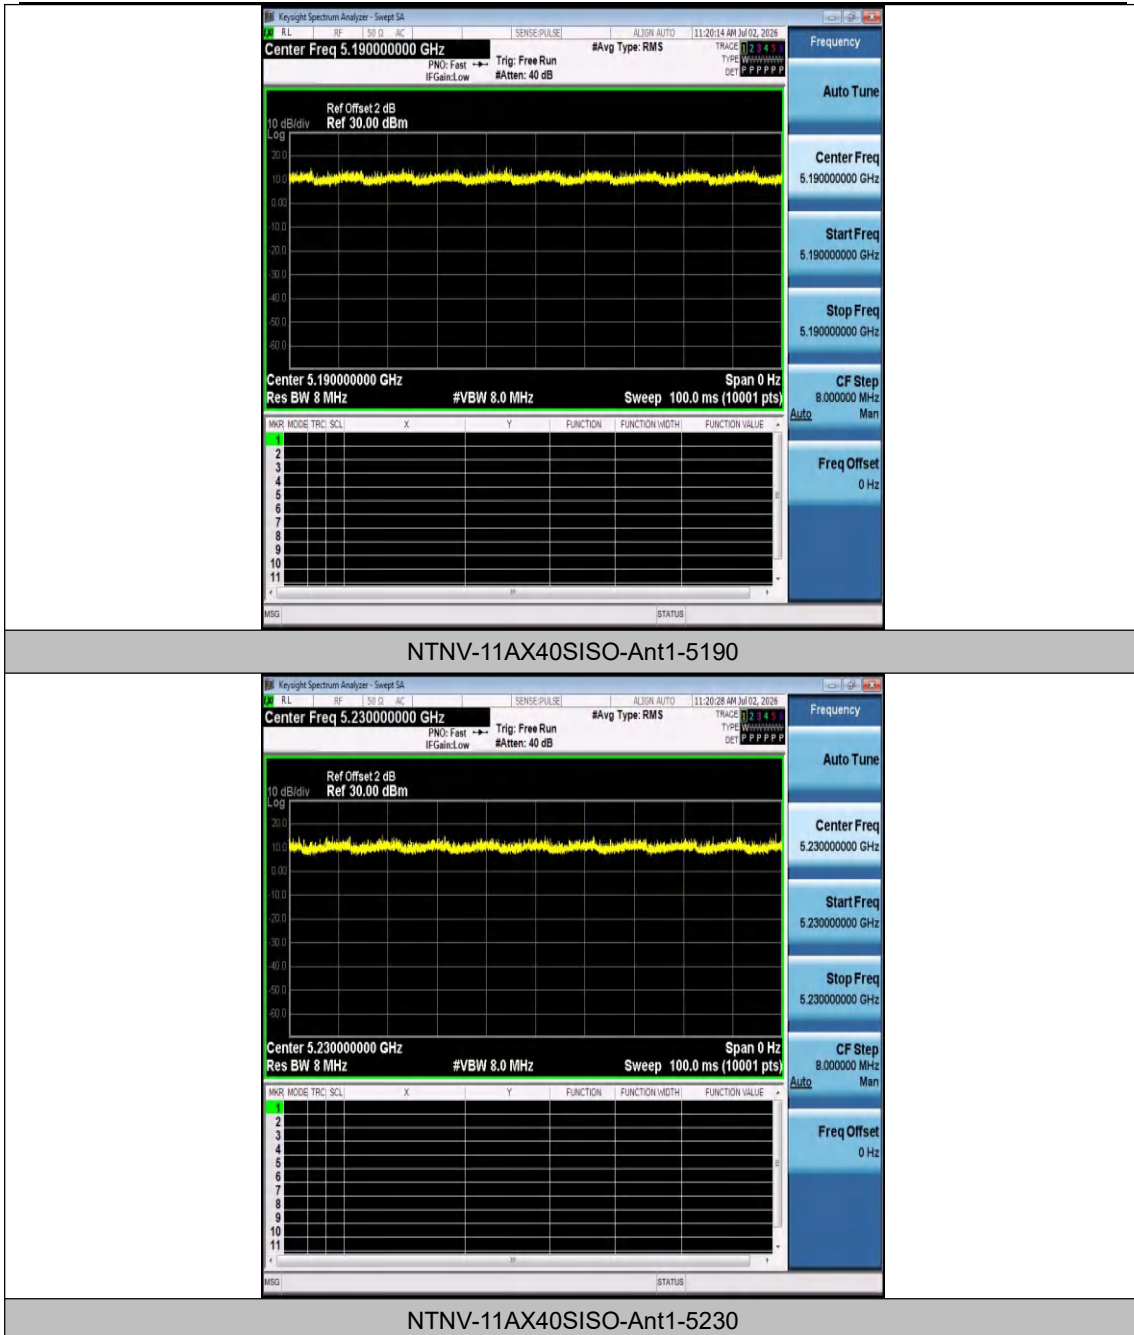


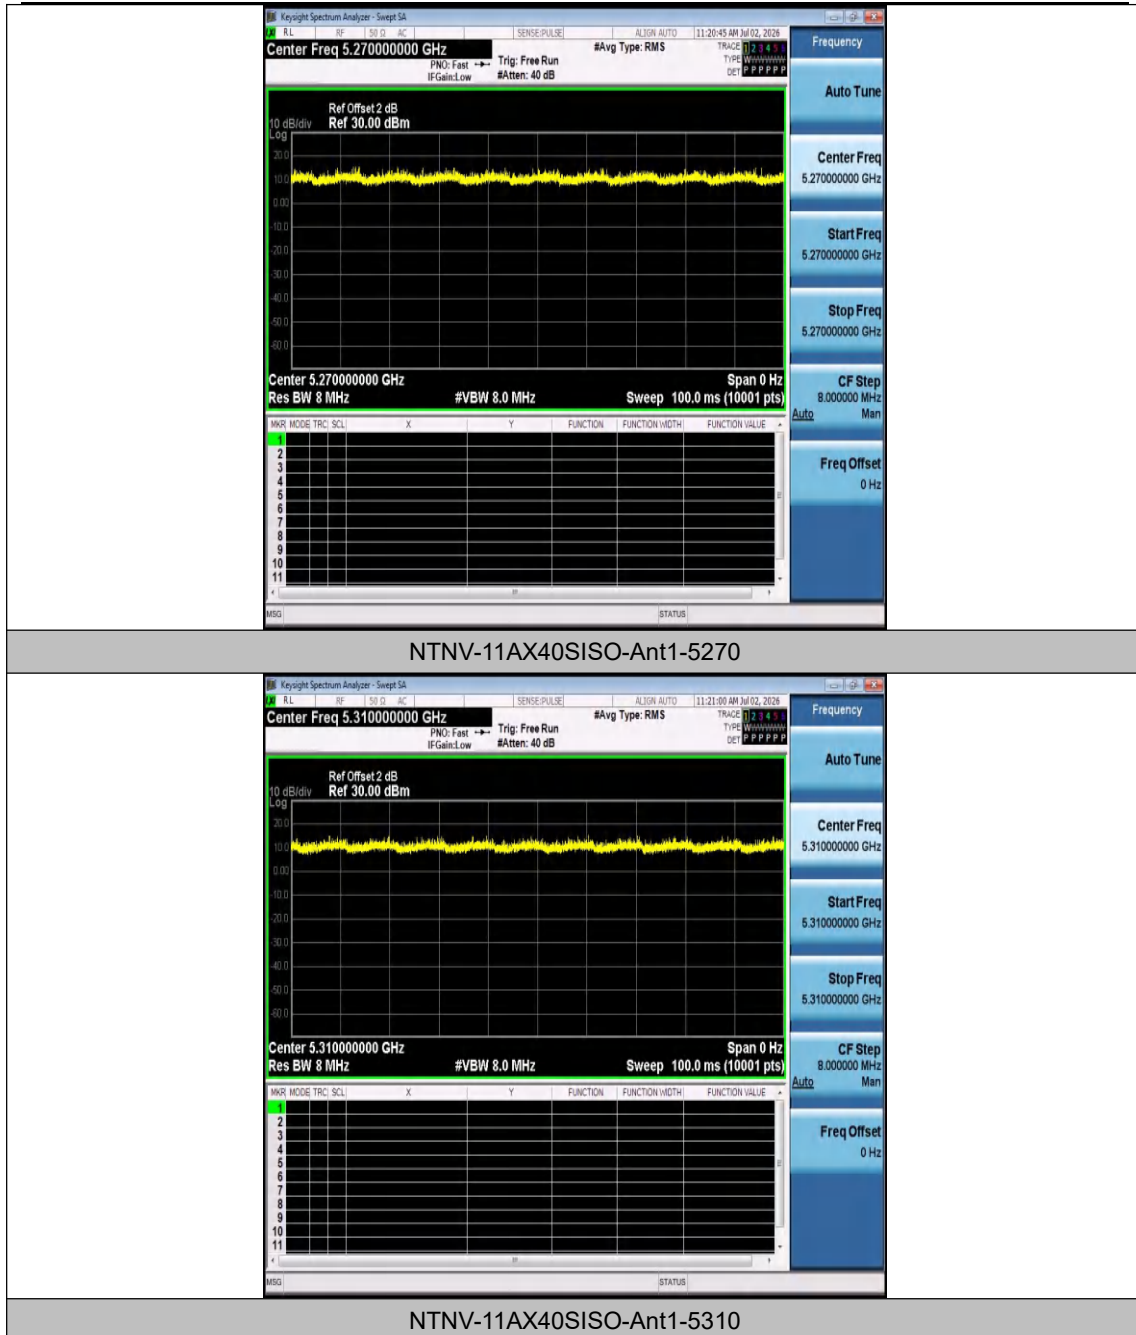

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

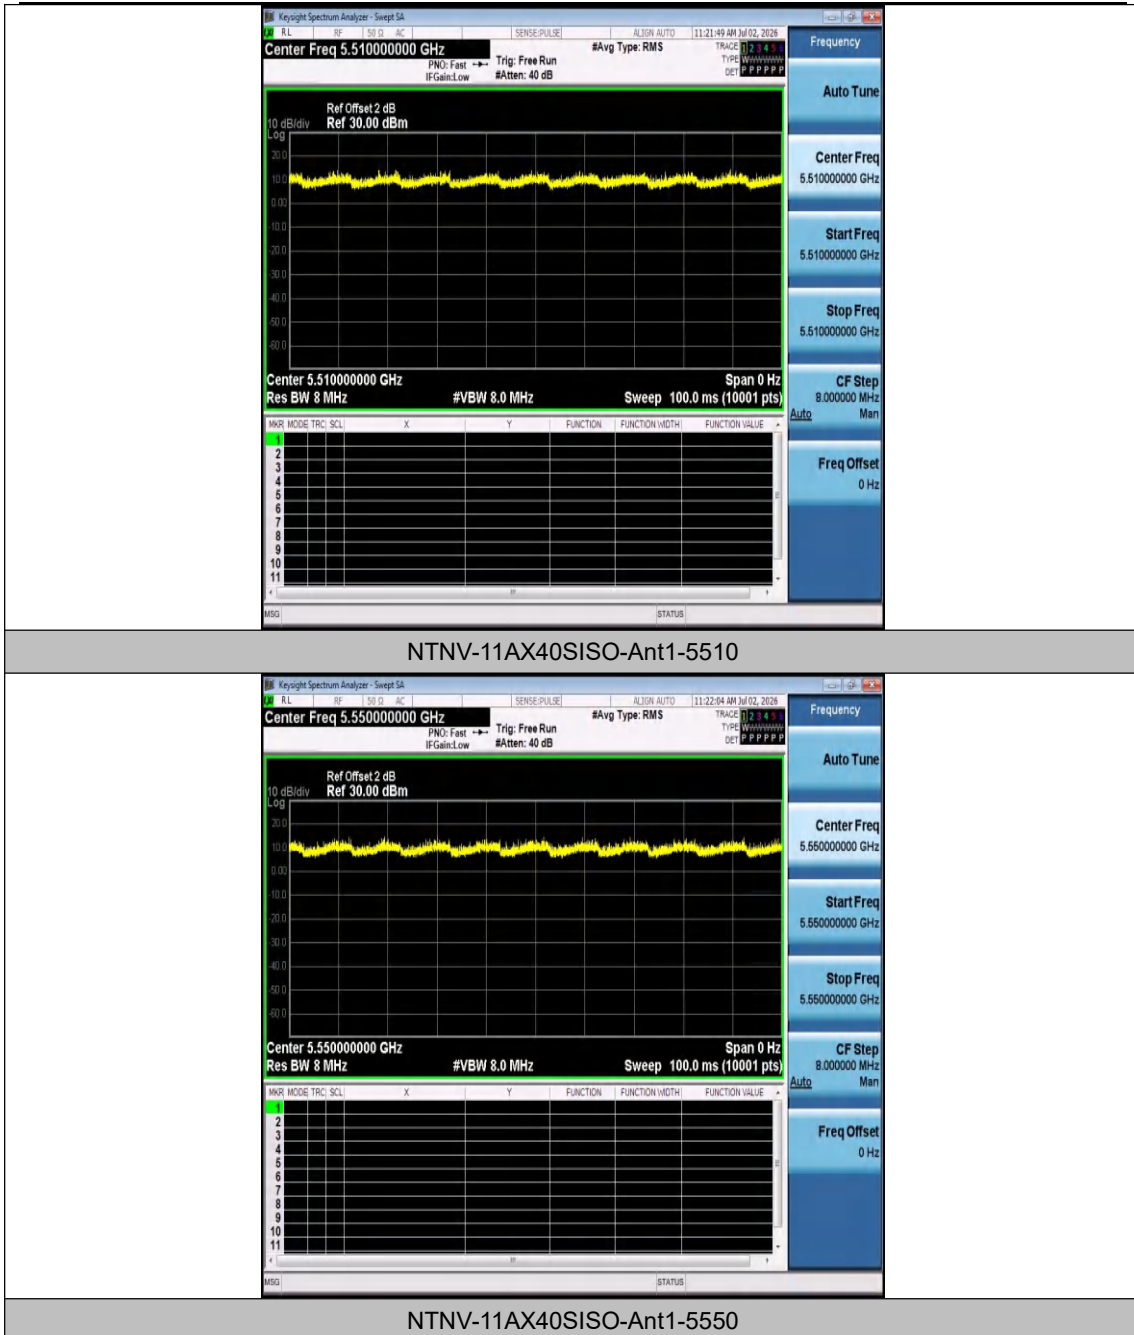


#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

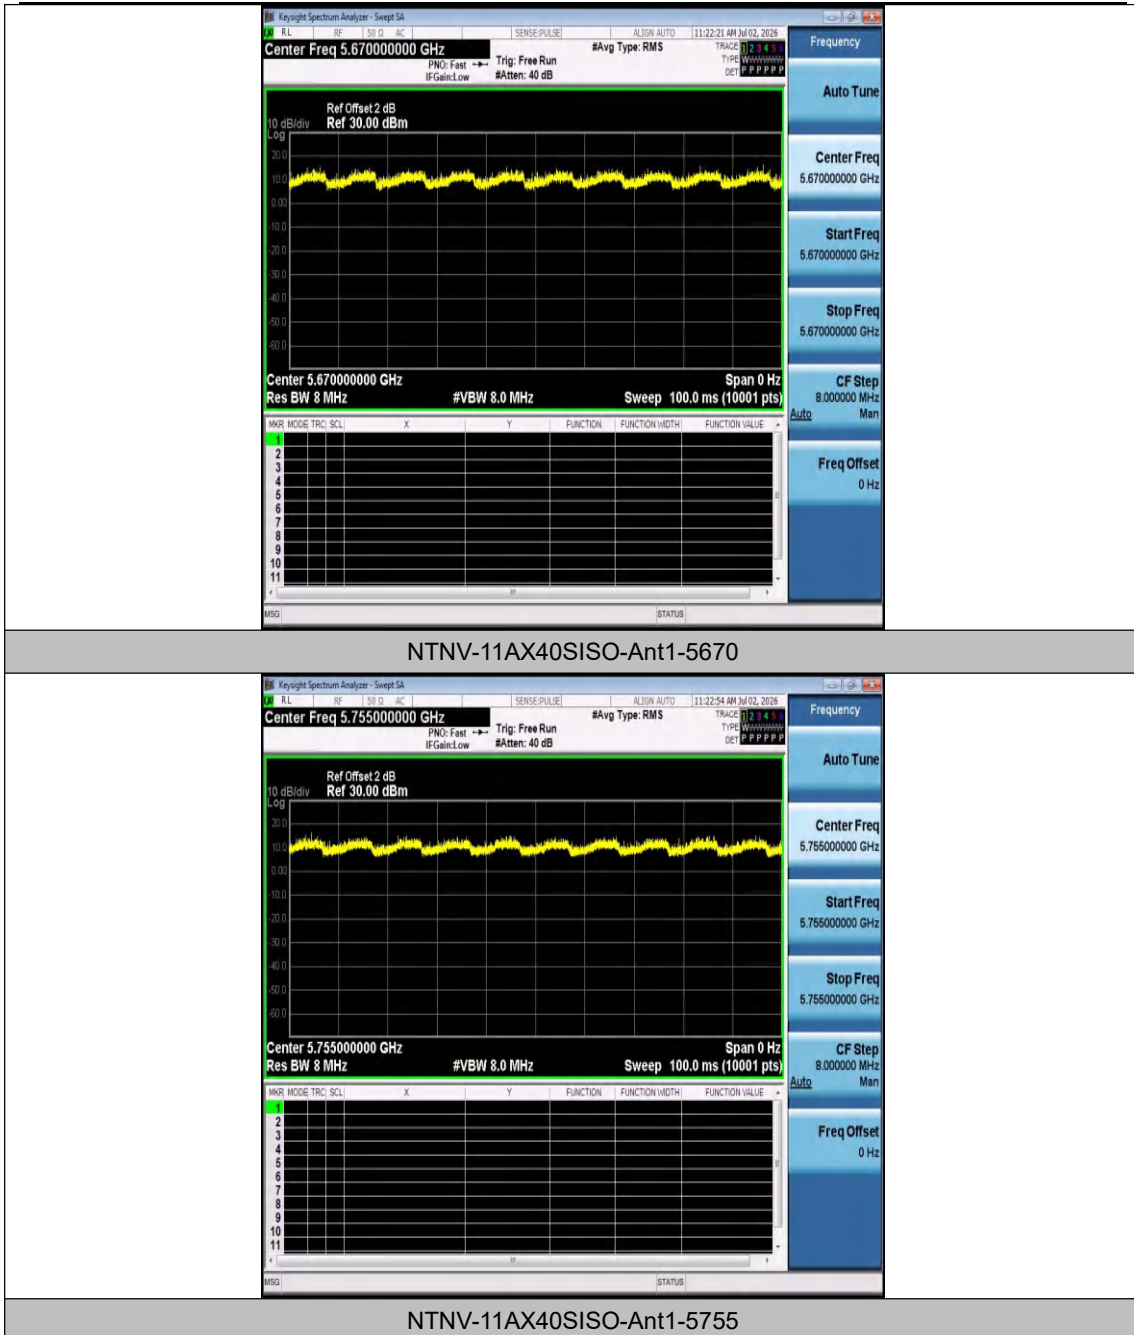

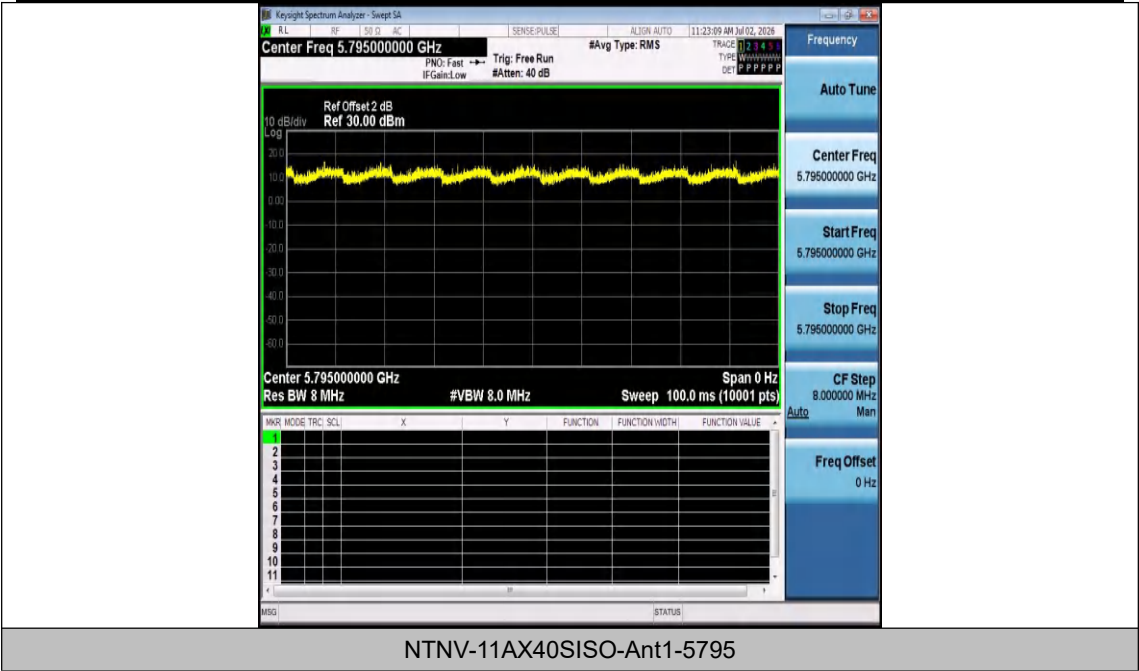

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

## Appendix C: Maximum Conducted Output Power

### Test Result Channel Power

| Test Mode  | Antenna | Frequency[MHz] | Result [dBm] | Limit [dBm] | Verdict |
|------------|---------|----------------|--------------|-------------|---------|
| 11A        | Ant1    | 5180           | 14.60        | ≤23.98      | PASS    |
| 11A        | Ant1    | 5220           | 14.50        | ≤23.98      | PASS    |
| 11A        | Ant1    | 5240           | 14.40        | ≤23.98      | PASS    |
| 11A        | Ant1    | 5260           | 14.21        | ≤23.98      | PASS    |
| 11A        | Ant1    | 5300           | 14.36        | ≤23.98      | PASS    |
| 11A        | Ant1    | 5320           | 14.79        | ≤23.98      | PASS    |
| 11A        | Ant1    | 5500           | 13.57        | ≤23.98      | PASS    |
| 11A        | Ant1    | 5580           | 14.81        | ≤23.98      | PASS    |
| 11A        | Ant1    | 5700           | 13.80        | ≤23.98      | PASS    |
| 11A        | Ant1    | 5745           | 13.85        | ≤30.00      | PASS    |
| 11A        | Ant1    | 5785           | 14.11        | ≤30.00      | PASS    |
| 11A        | Ant1    | 5825           | 14.25        | ≤30.00      | PASS    |
| 11N20SISO  | Ant1    | 5180           | 14.41        | ≤23.98      | PASS    |
| 11N20SISO  | Ant1    | 5220           | 14.55        | ≤23.98      | PASS    |
| 11N20SISO  | Ant1    | 5240           | 14.17        | ≤23.98      | PASS    |
| 11N20SISO  | Ant1    | 5260           | 14.07        | ≤23.98      | PASS    |
| 11N20SISO  | Ant1    | 5300           | 14.28        | ≤23.98      | PASS    |
| 11N20SISO  | Ant1    | 5320           | 14.62        | ≤23.98      | PASS    |
| 11N20SISO  | Ant1    | 5500           | 13.52        | ≤23.98      | PASS    |
| 11N20SISO  | Ant1    | 5580           | 14.71        | ≤23.98      | PASS    |
| 11N20SISO  | Ant1    | 5700           | 13.54        | ≤23.98      | PASS    |
| 11N20SISO  | Ant1    | 5745           | 13.80        | ≤30.00      | PASS    |
| 11N20SISO  | Ant1    | 5785           | 14.08        | ≤30.00      | PASS    |
| 11N20SISO  | Ant1    | 5825           | 14.25        | ≤30.00      | PASS    |
| 11N40SISO  | Ant1    | 5190           | 14.96        | ≤23.98      | PASS    |
| 11N40SISO  | Ant1    | 5230           | 14.61        | ≤23.98      | PASS    |
| 11N40SISO  | Ant1    | 5270           | 14.19        | ≤23.98      | PASS    |
| 11N40SISO  | Ant1    | 5310           | 14.43        | ≤23.98      | PASS    |
| 11N40SISO  | Ant1    | 5510           | 13.99        | ≤23.98      | PASS    |
| 11N40SISO  | Ant1    | 5550           | 14.58        | ≤23.98      | PASS    |
| 11N40SISO  | Ant1    | 5670           | 14.39        | ≤23.98      | PASS    |
| 11N40SISO  | Ant1    | 5755           | 14.37        | ≤30.00      | PASS    |
| 11N40SISO  | Ant1    | 5795           | 14.42        | ≤30.00      | PASS    |
| 11AC20SISO | Ant1    | 5180           | 14.96        | ≤23.98      | PASS    |
| 11AC20SISO | Ant1    | 5220           | 14.68        | ≤23.98      | PASS    |
| 11AC20SISO | Ant1    | 5240           | 14.57        | ≤23.98      | PASS    |
| 11AC20SISO | Ant1    | 5260           | 14.36        | ≤23.98      | PASS    |

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

|            |      |      |       |        |      |
|------------|------|------|-------|--------|------|
| 11AC20SISO | Ant1 | 5300 | 14.18 | ≤23.98 | PASS |
| 11AC20SISO | Ant1 | 5320 | 14.37 | ≤23.98 | PASS |
| 11AC20SISO | Ant1 | 5500 | 13.76 | ≤23.98 | PASS |
| 11AC20SISO | Ant1 | 5580 | 14.97 | ≤23.98 | PASS |
| 11AC20SISO | Ant1 | 5700 | 13.98 | ≤23.98 | PASS |
| 11AC20SISO | Ant1 | 5745 | 14.13 | ≤30.00 | PASS |
| 11AC20SISO | Ant1 | 5785 | 14.39 | ≤30.00 | PASS |
| 11AC20SISO | Ant1 | 5825 | 14.54 | ≤30.00 | PASS |
| 11AC40SISO | Ant1 | 5190 | 14.57 | ≤23.98 | PASS |
| 11AC40SISO | Ant1 | 5230 | 14.76 | ≤23.98 | PASS |
| 11AC40SISO | Ant1 | 5270 | 14.20 | ≤23.98 | PASS |
| 11AC40SISO | Ant1 | 5310 | 14.43 | ≤23.98 | PASS |
| 11AC40SISO | Ant1 | 5510 | 14.11 | ≤23.98 | PASS |
| 11AC40SISO | Ant1 | 5550 | 14.68 | ≤23.98 | PASS |
| 11AC40SISO | Ant1 | 5670 | 14.50 | ≤23.98 | PASS |
| 11AC40SISO | Ant1 | 5755 | 14.26 | ≤30.00 | PASS |
| 11AC40SISO | Ant1 | 5795 | 14.46 | ≤30.00 | PASS |
| 11AX20SISO | Ant1 | 5180 | 15.89 | ≤23.98 | PASS |
| 11AX20SISO | Ant1 | 5220 | 15.35 | ≤23.98 | PASS |
| 11AX20SISO | Ant1 | 5240 | 15.36 | ≤23.98 | PASS |
| 11AX20SISO | Ant1 | 5260 | 15.25 | ≤23.98 | PASS |
| 11AX20SISO | Ant1 | 5300 | 14.96 | ≤23.98 | PASS |
| 11AX20SISO | Ant1 | 5320 | 15.29 | ≤23.98 | PASS |
| 11AX20SISO | Ant1 | 5500 | 14.60 | ≤23.98 | PASS |
| 11AX20SISO | Ant1 | 5580 | 15.82 | ≤23.98 | PASS |
| 11AX20SISO | Ant1 | 5700 | 14.93 | ≤23.98 | PASS |
| 11AX20SISO | Ant1 | 5745 | 15.07 | ≤30.00 | PASS |
| 11AX20SISO | Ant1 | 5785 | 15.35 | ≤30.00 | PASS |
| 11AX20SISO | Ant1 | 5825 | 15.43 | ≤30.00 | PASS |
| 11AX40SISO | Ant1 | 5190 | 15.33 | ≤23.98 | PASS |
| 11AX40SISO | Ant1 | 5230 | 15.54 | ≤23.98 | PASS |
| 11AX40SISO | Ant1 | 5270 | 15.16 | ≤23.98 | PASS |
| 11AX40SISO | Ant1 | 5310 | 15.57 | ≤23.98 | PASS |
| 11AX40SISO | Ant1 | 5510 | 14.78 | ≤23.98 | PASS |
| 11AX40SISO | Ant1 | 5550 | 15.53 | ≤23.98 | PASS |
| 11AX40SISO | Ant1 | 5670 | 15.31 | ≤23.98 | PASS |
| 11AX40SISO | Ant1 | 5755 | 15.07 | ≤30.00 | PASS |
| 11AX40SISO | Ant1 | 5795 | 15.36 | ≤30.00 | PASS |

Note: 1.The cable loss are compensated in the graph.

## Test Graphs Channel Power



### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)



### Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

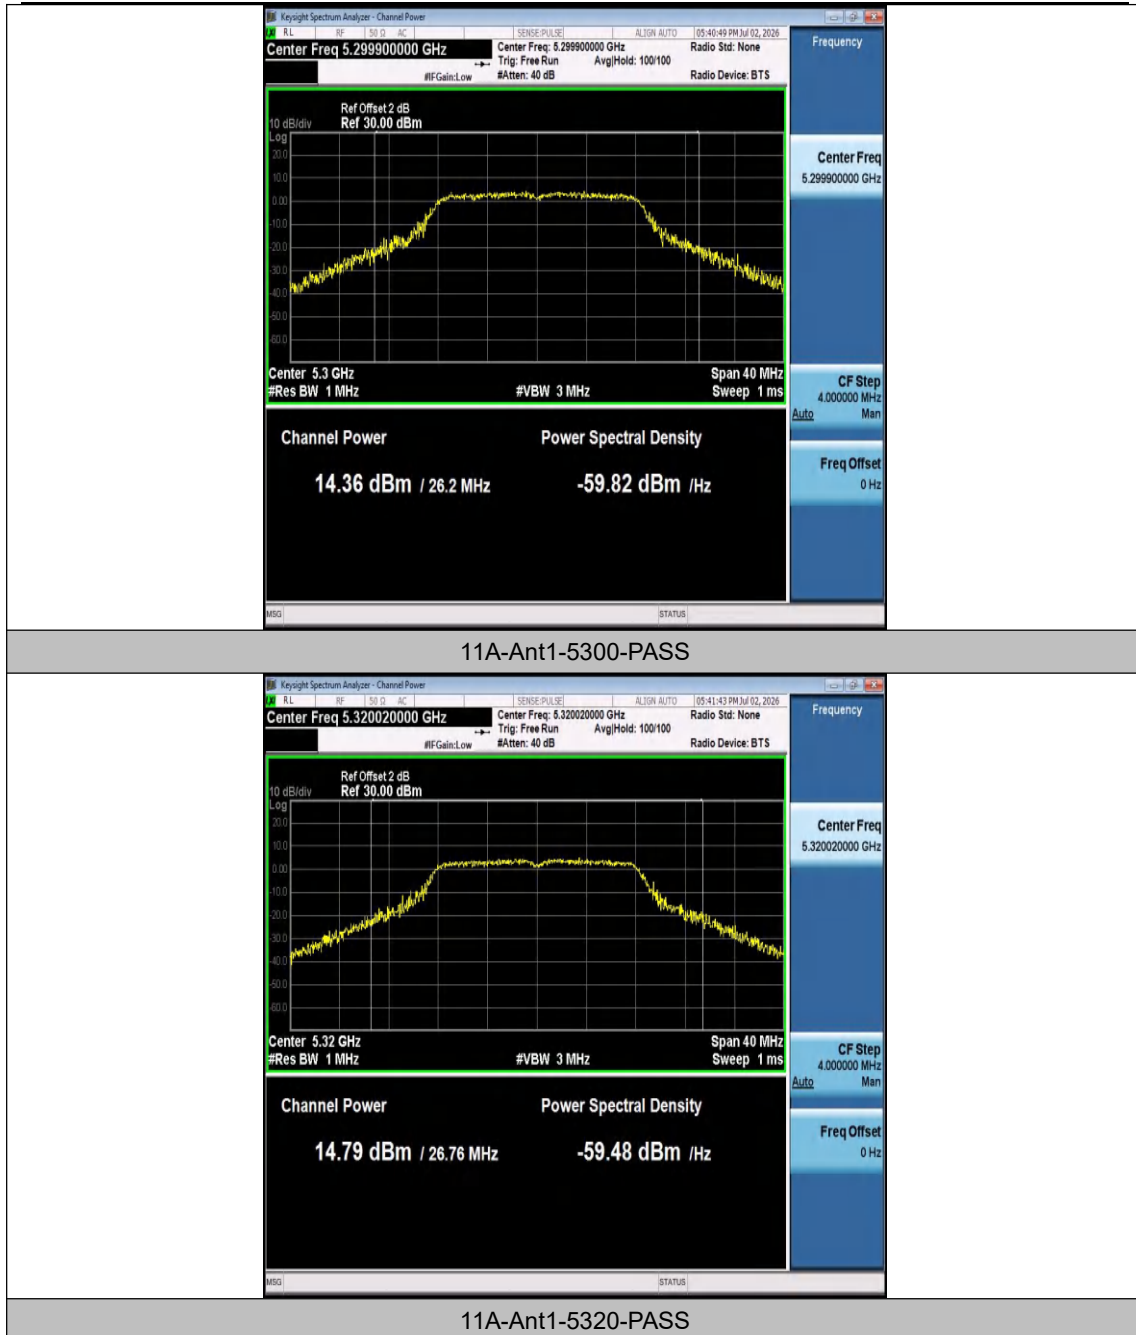






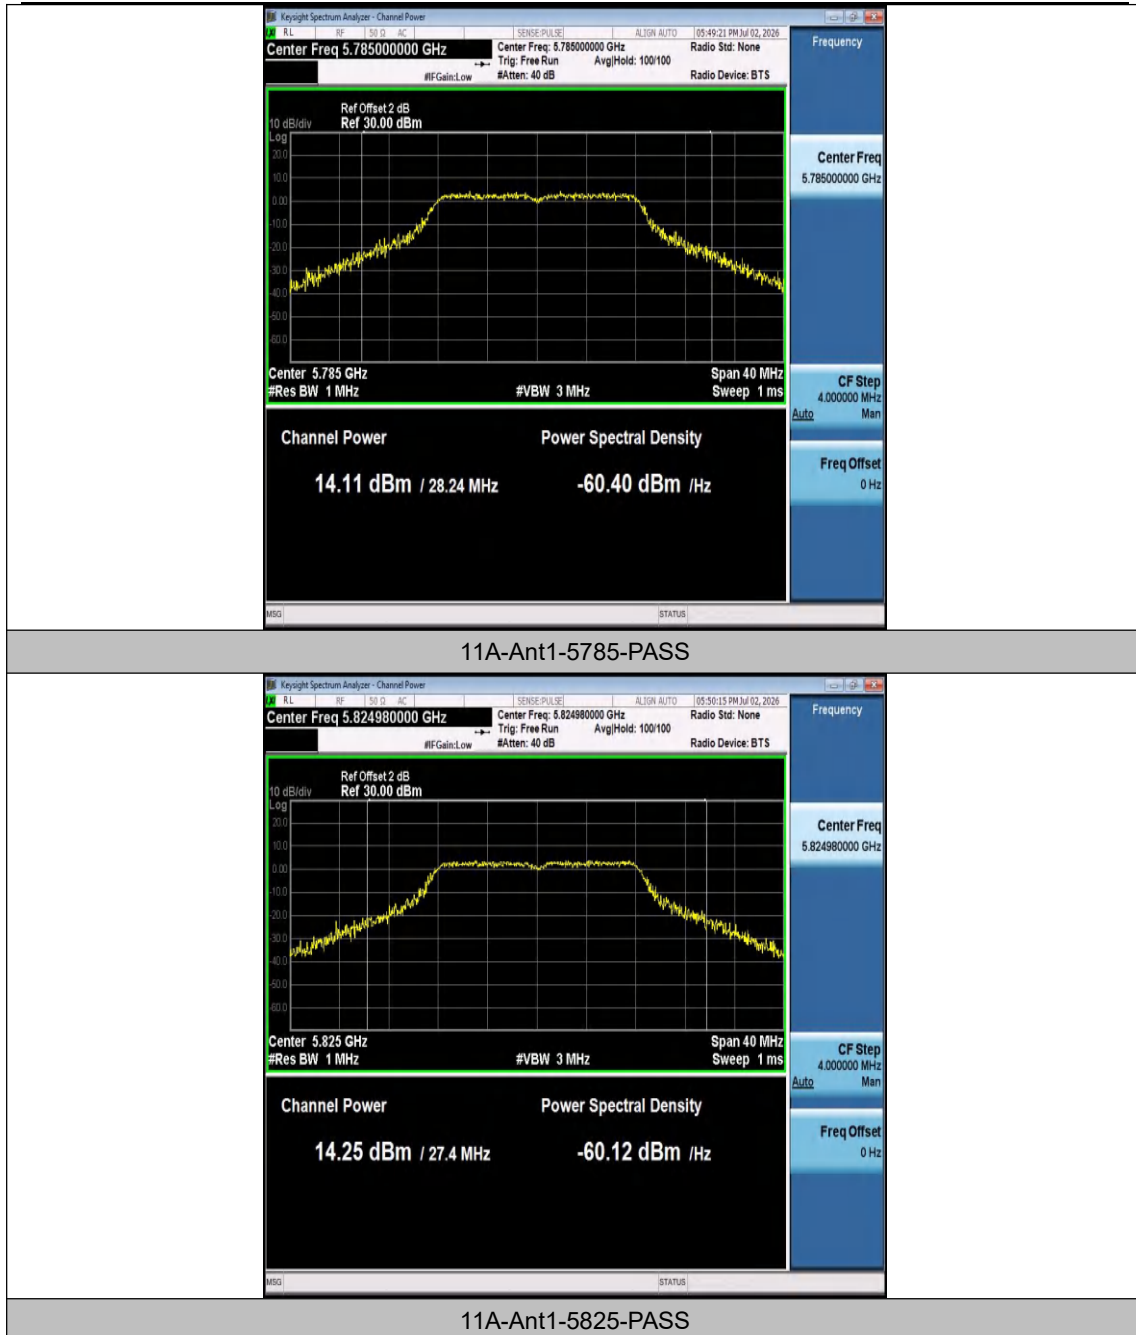

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

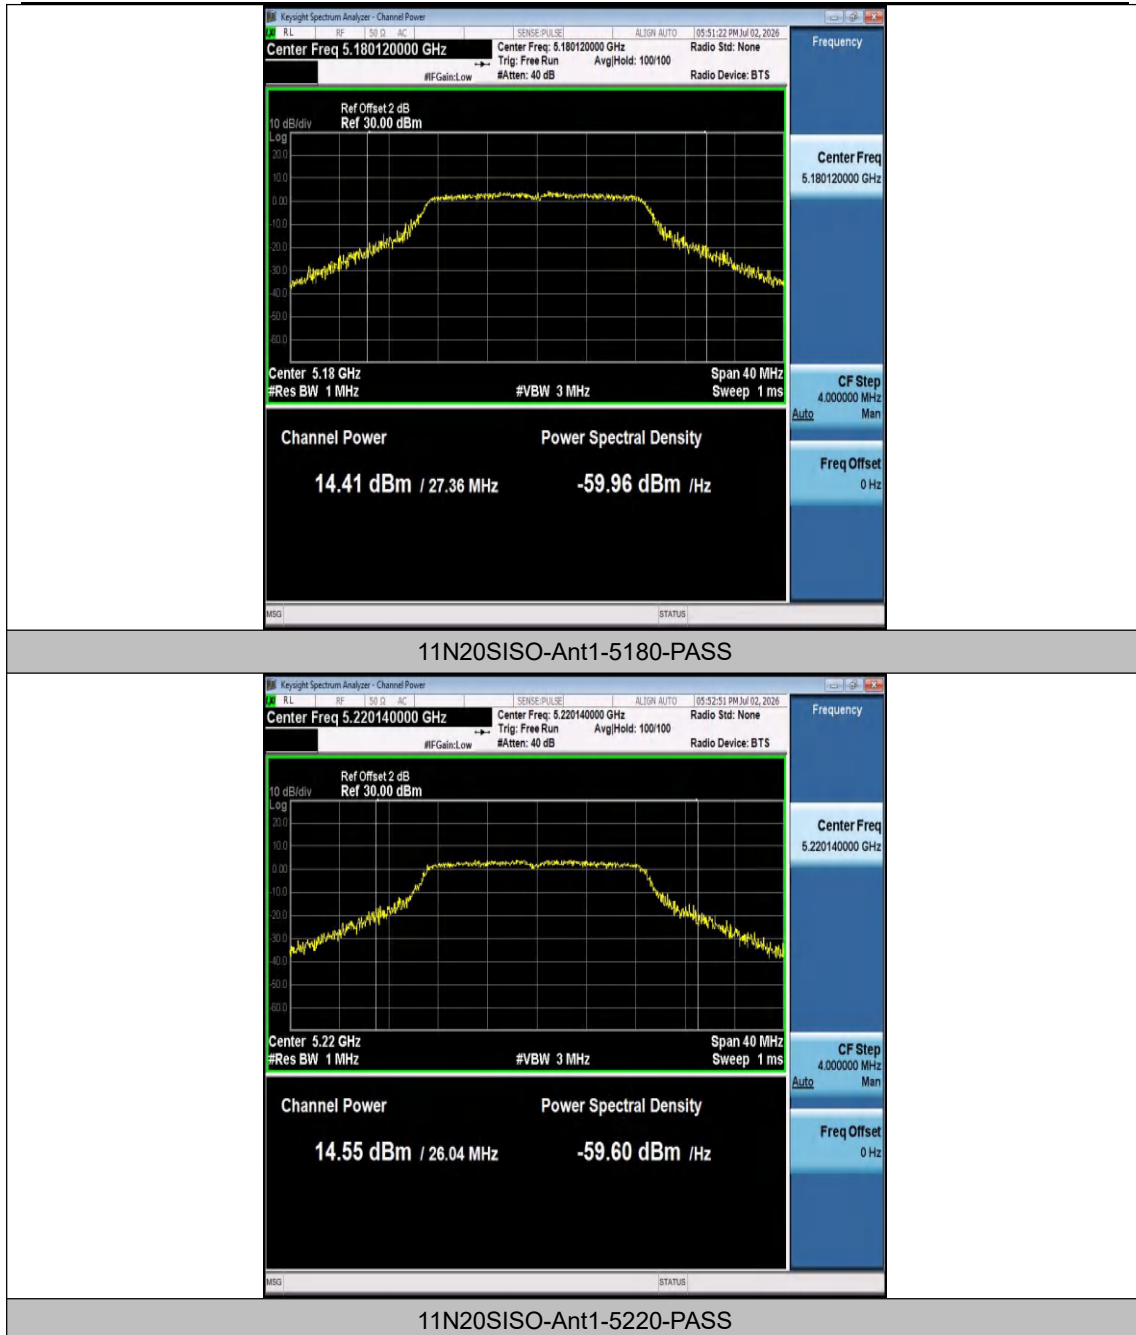




### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

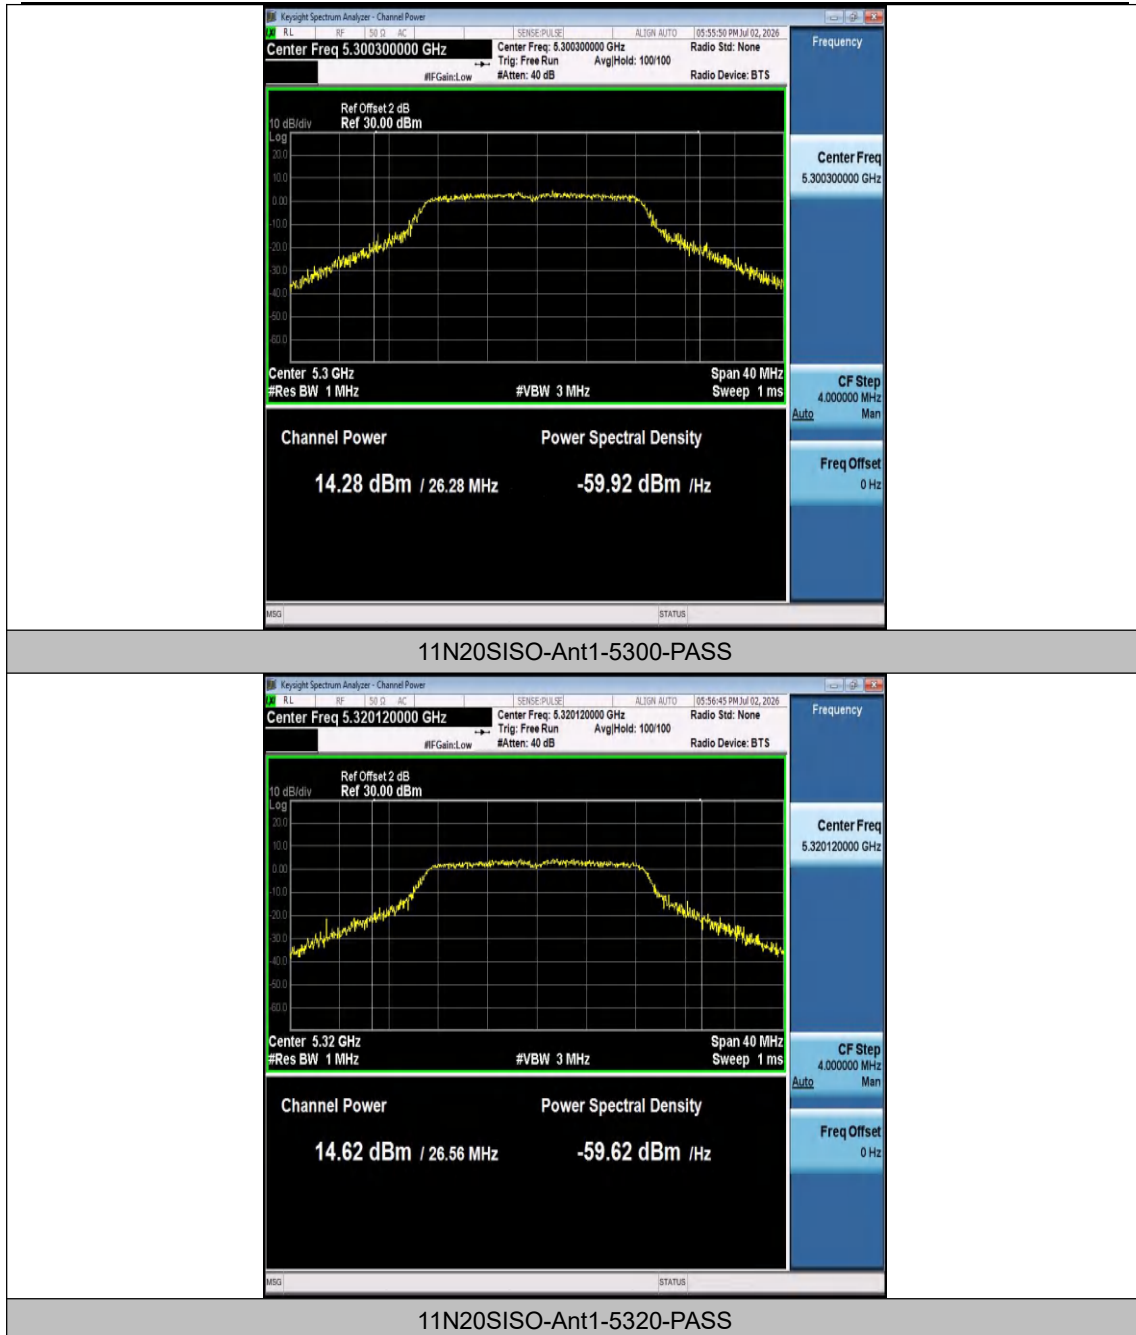

**Shenzhen Anbotek Compliance Laboratory Limited**

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)




#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)






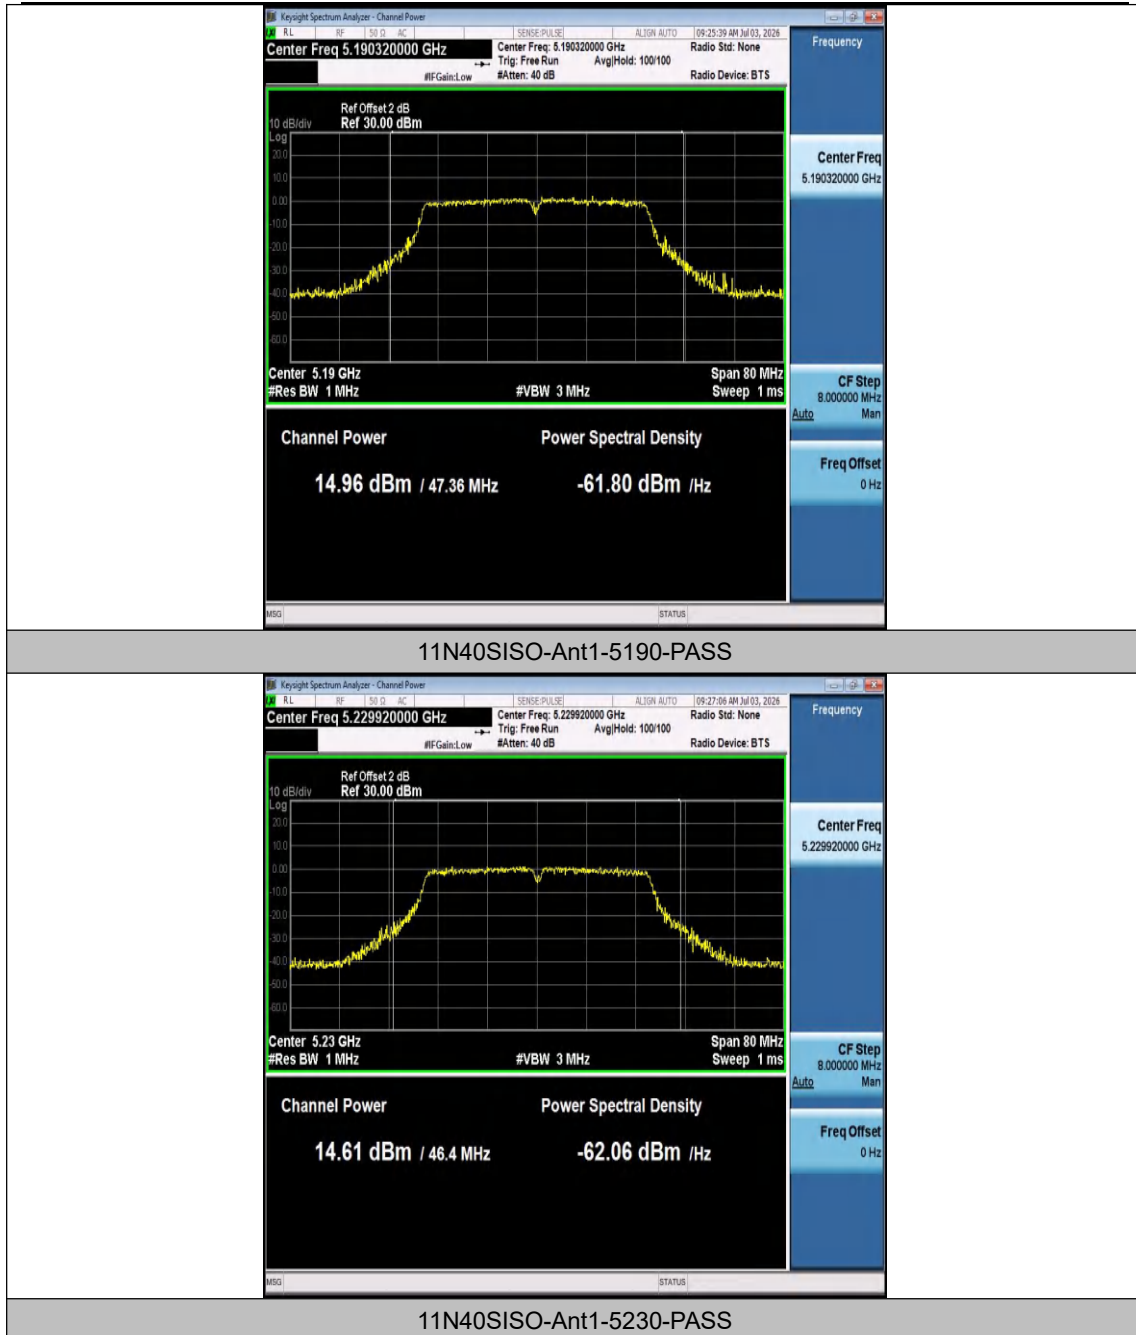



#### Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

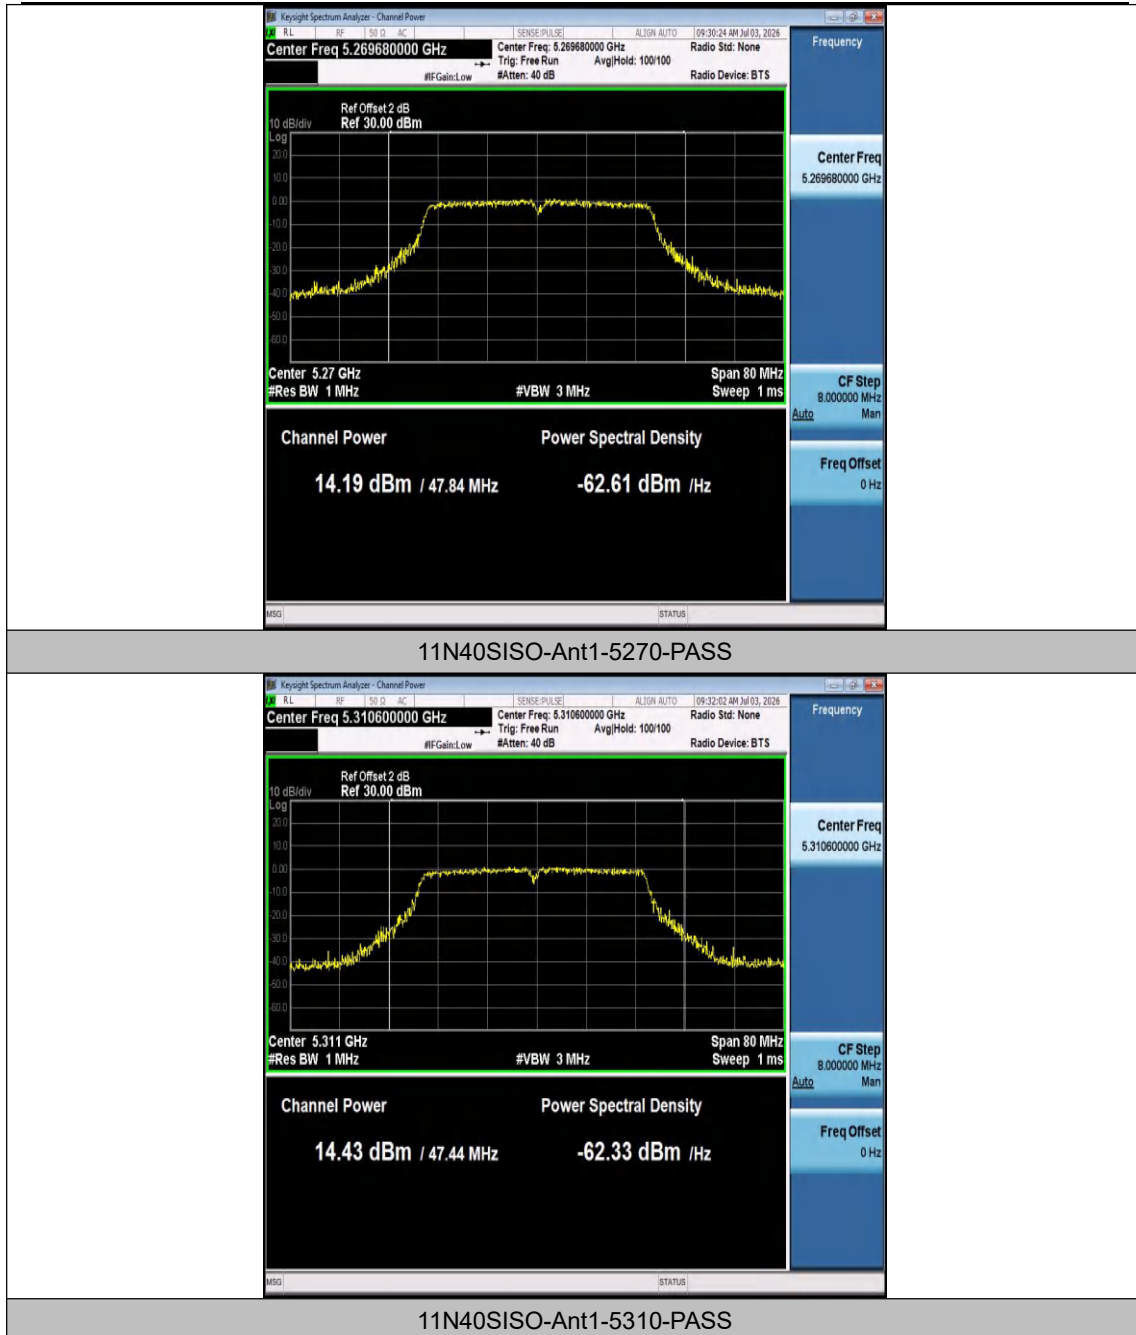


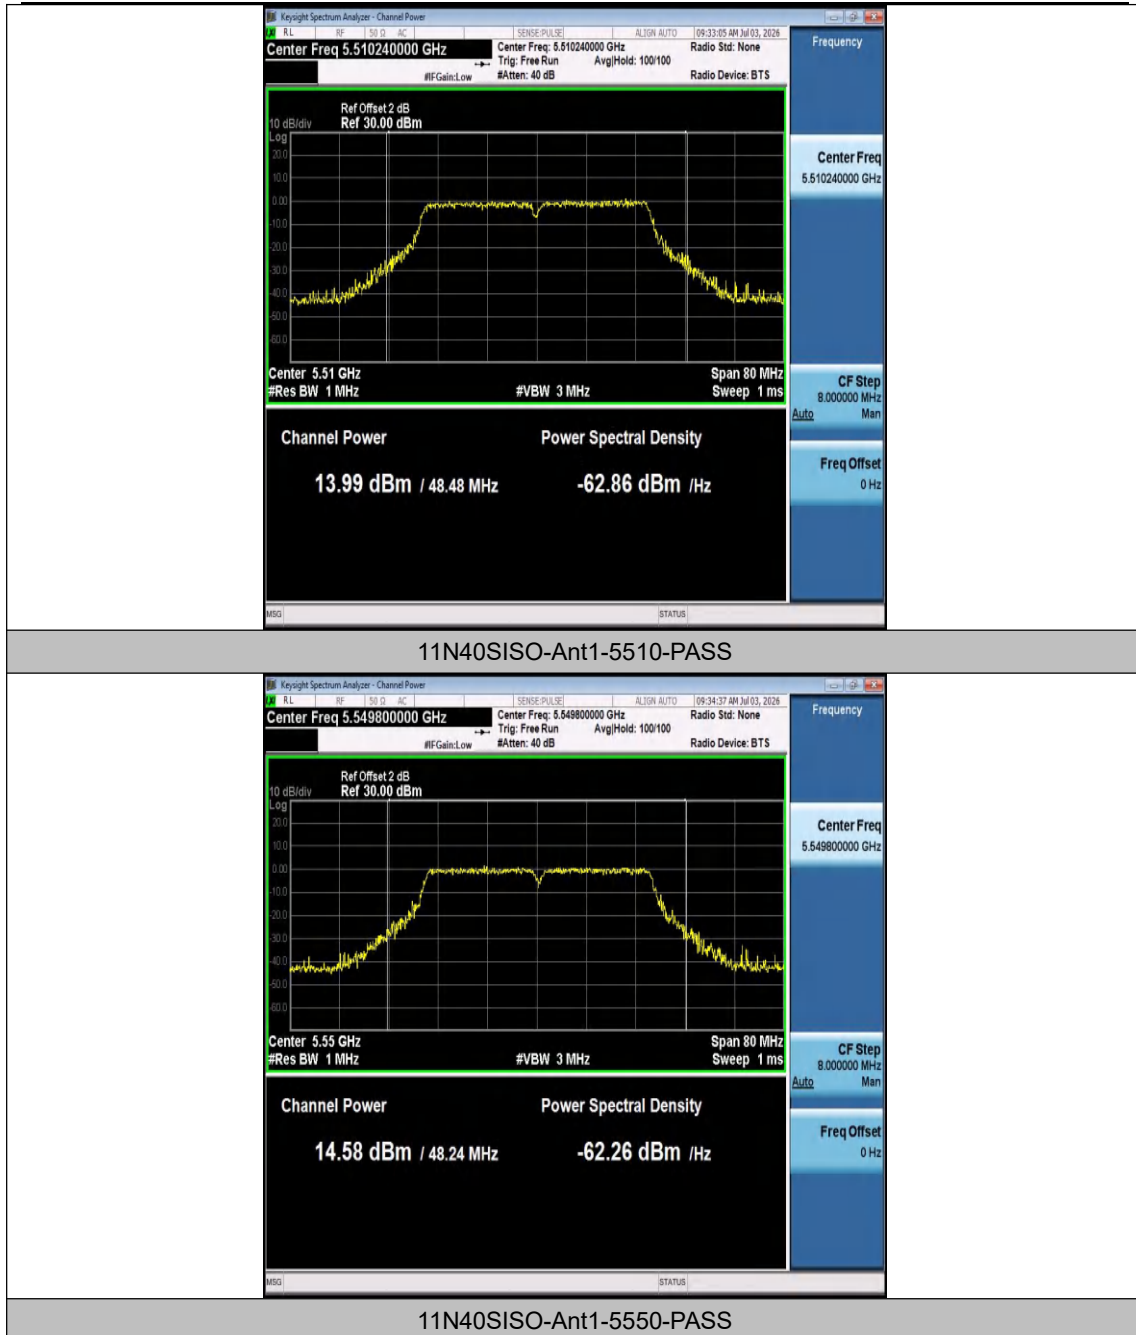

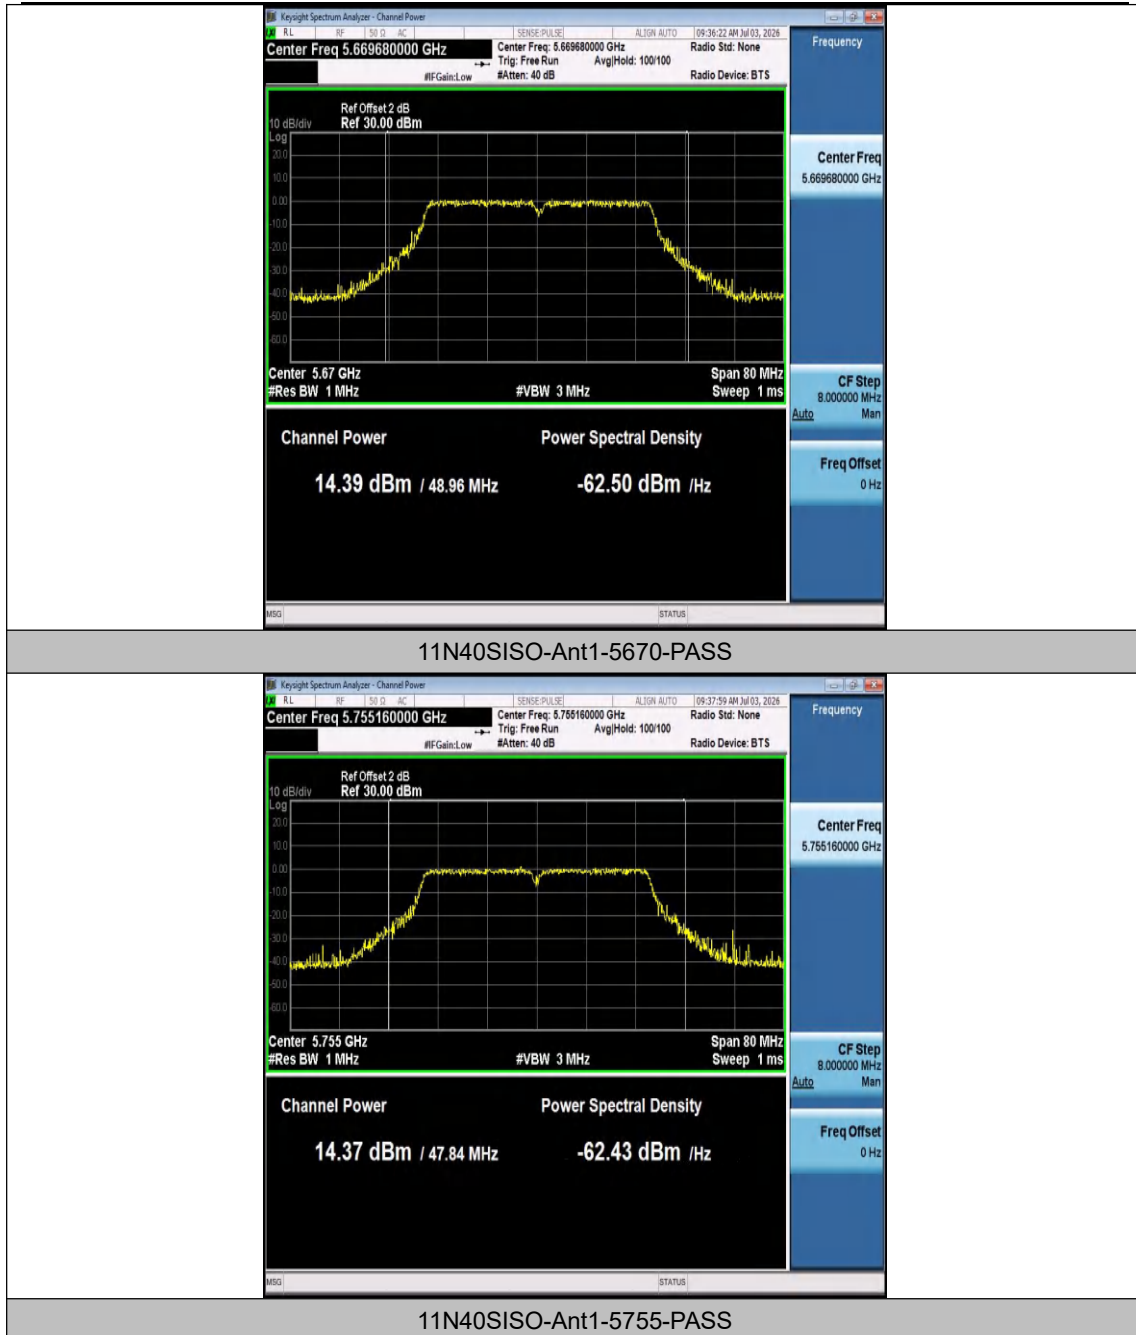

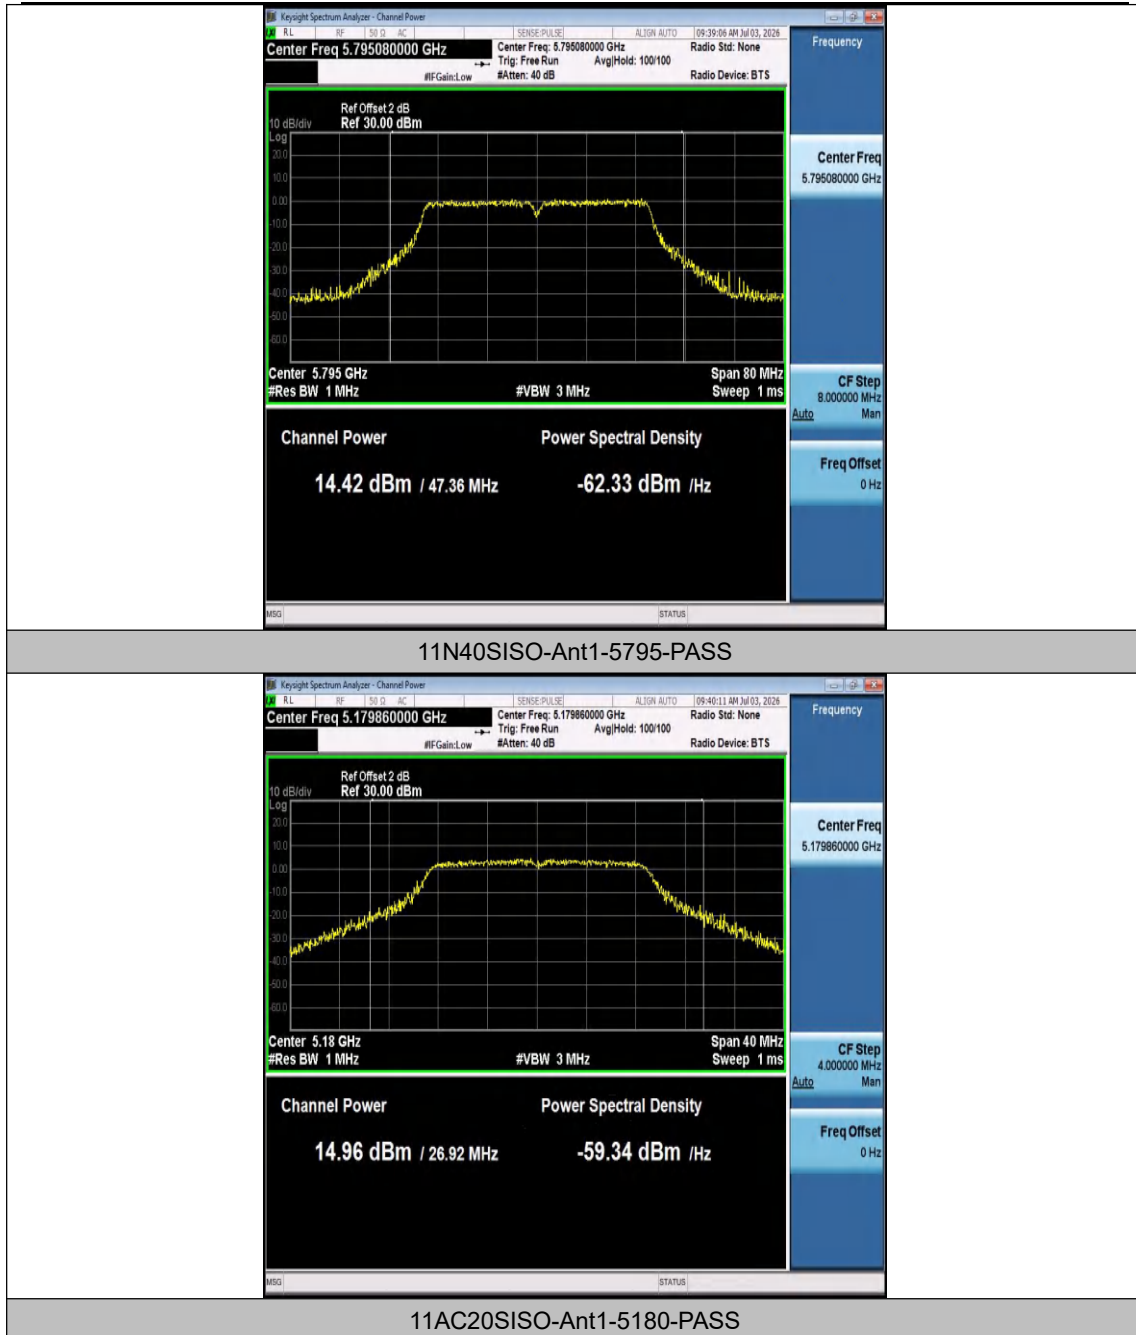

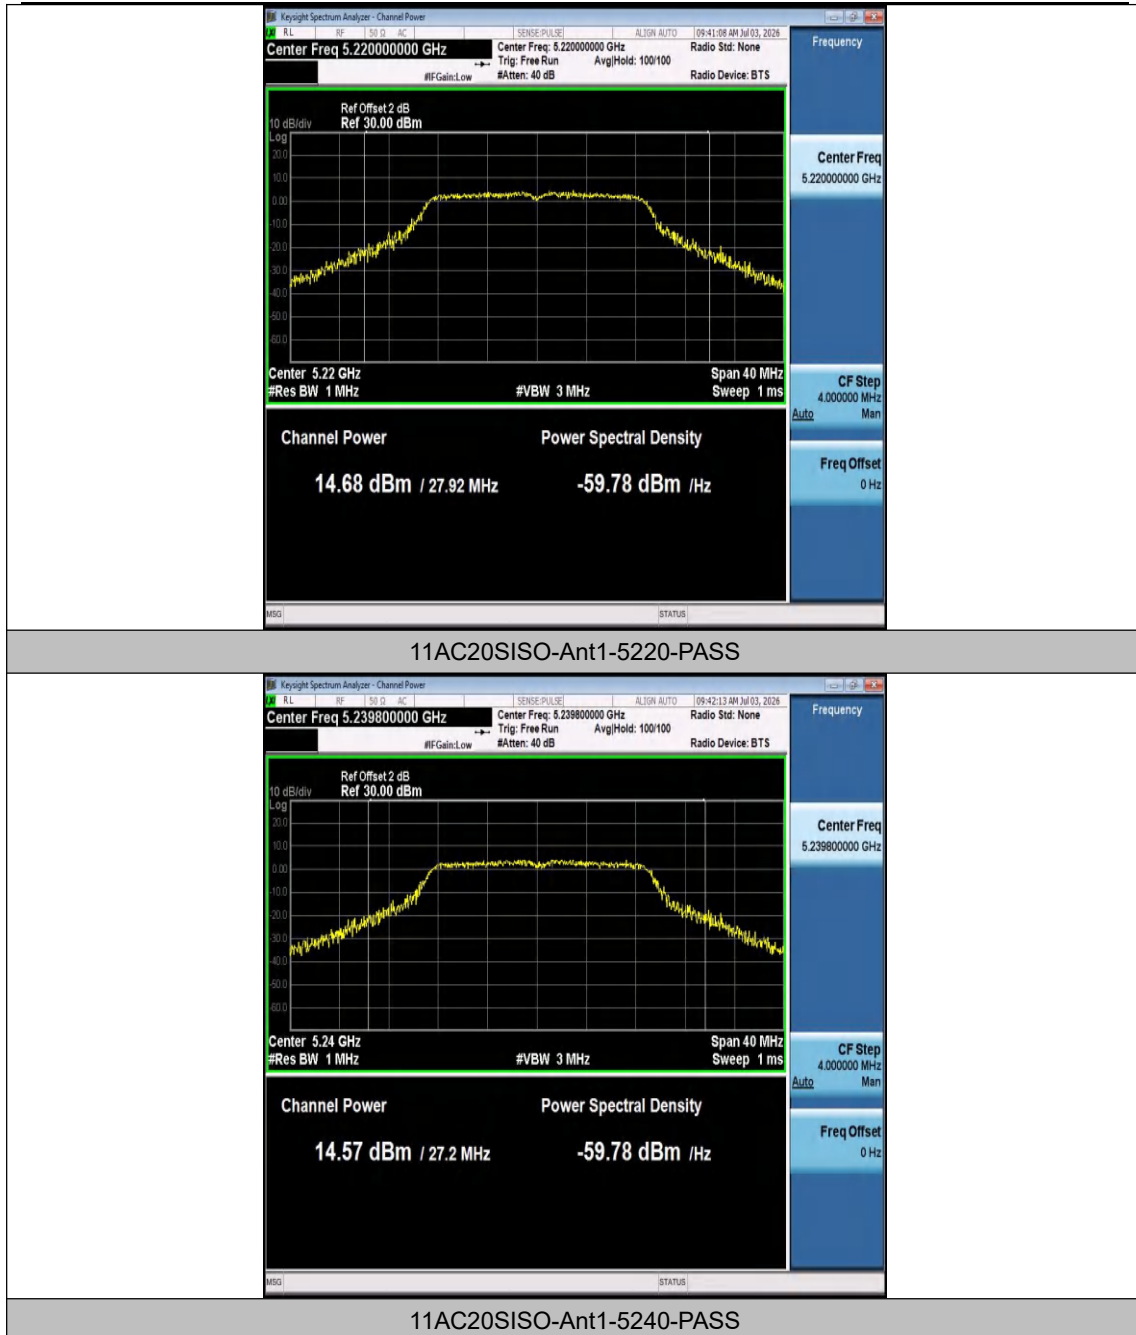

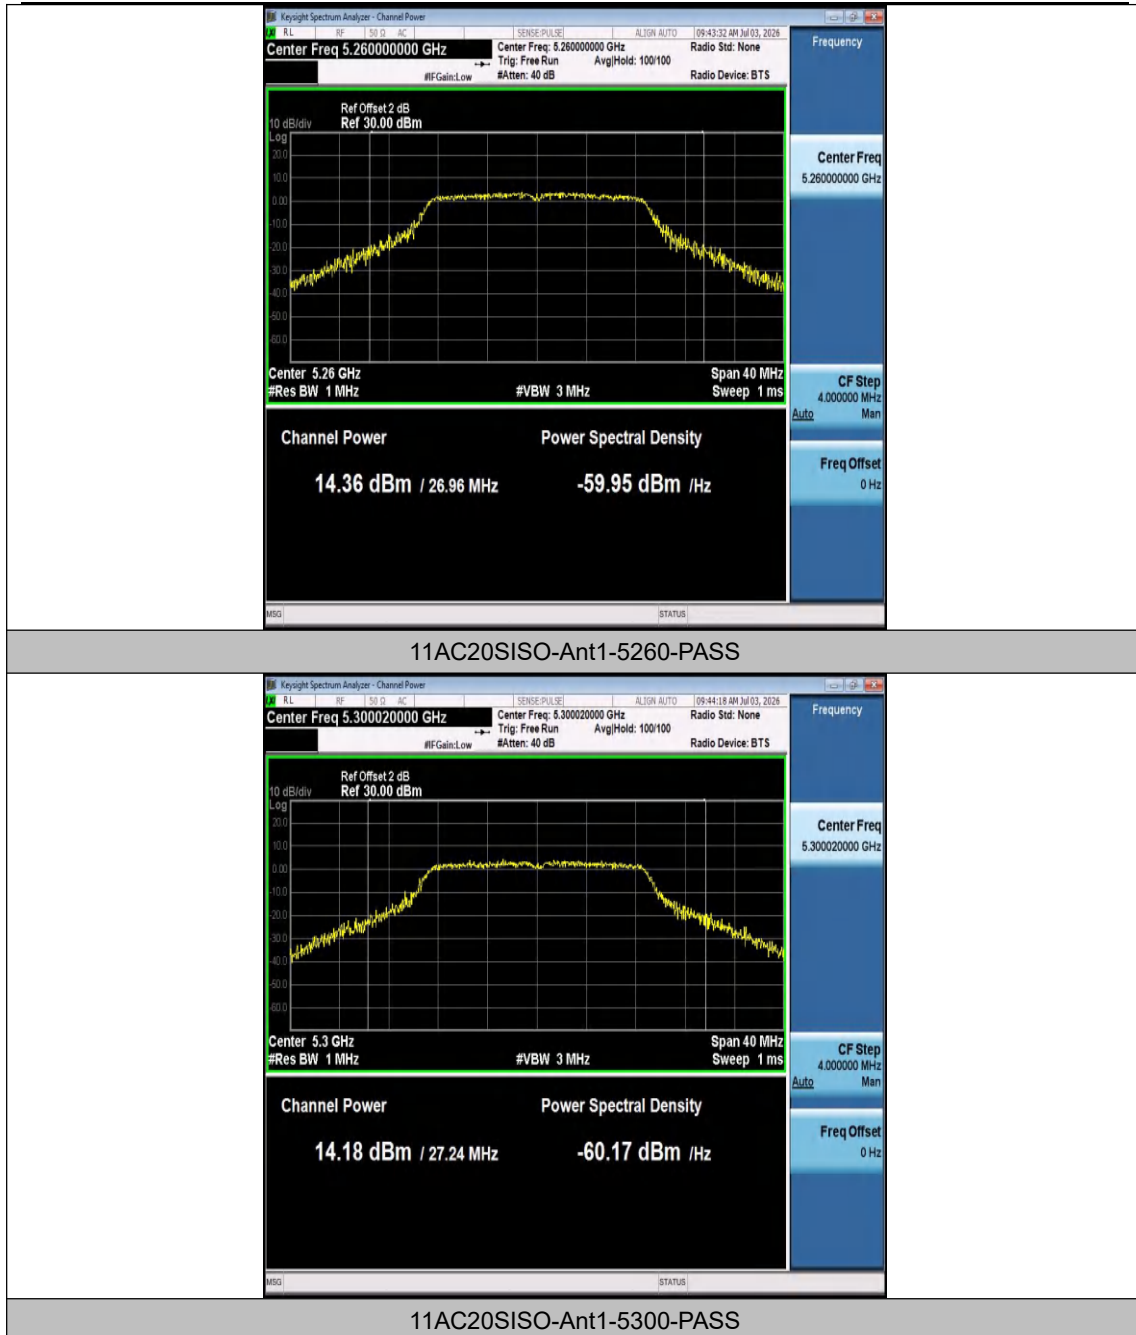



#### Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)




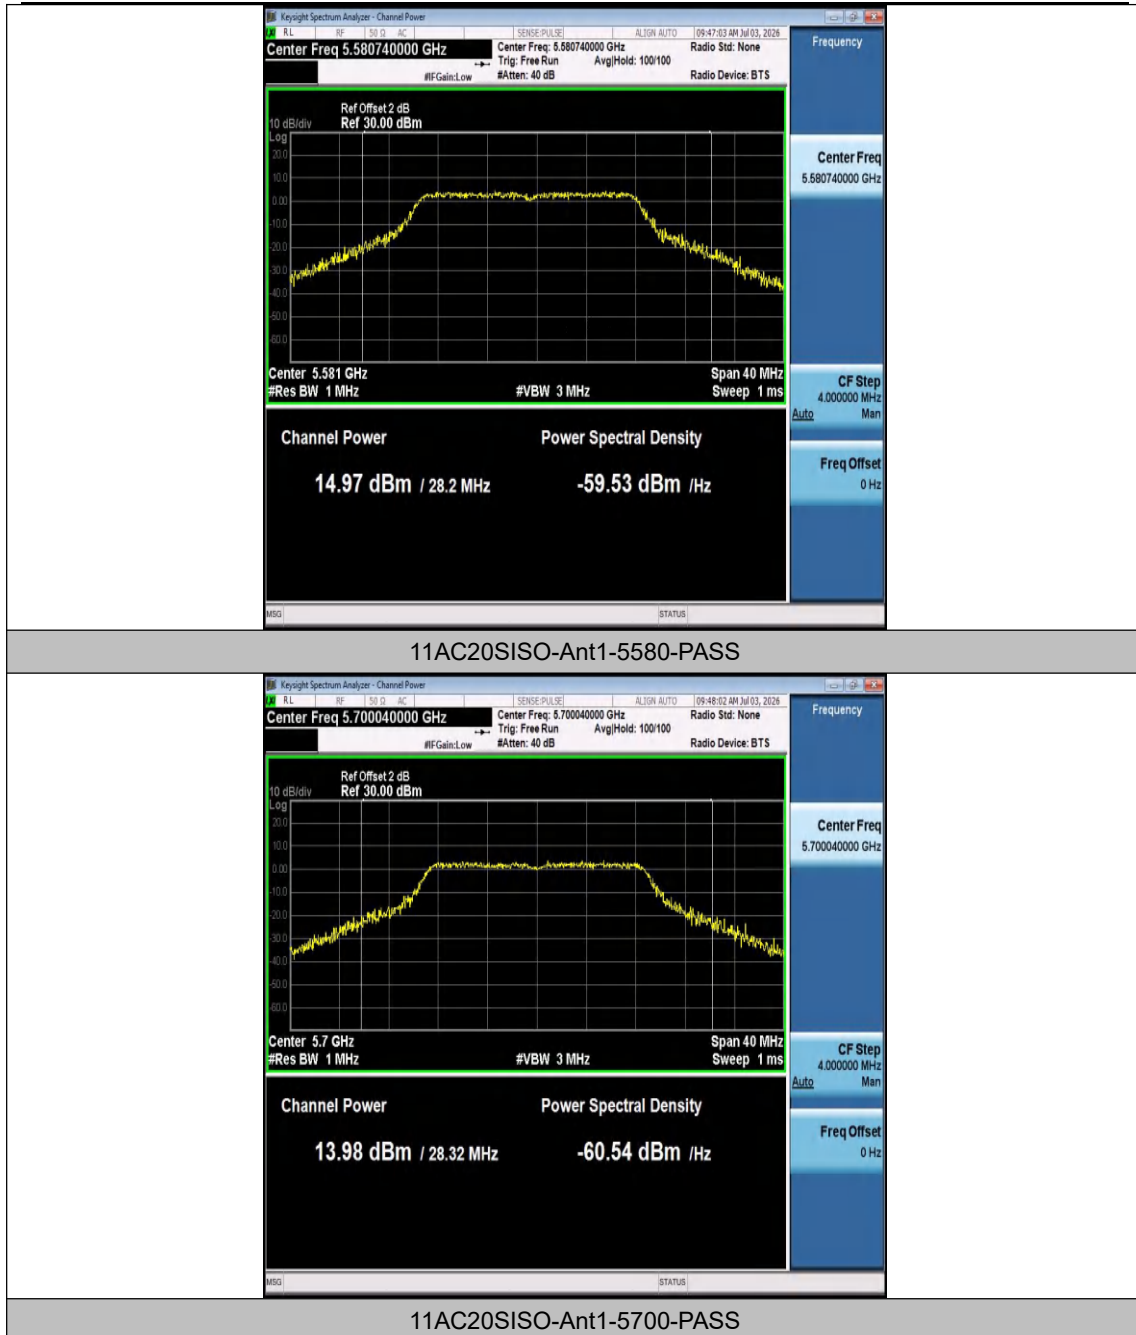


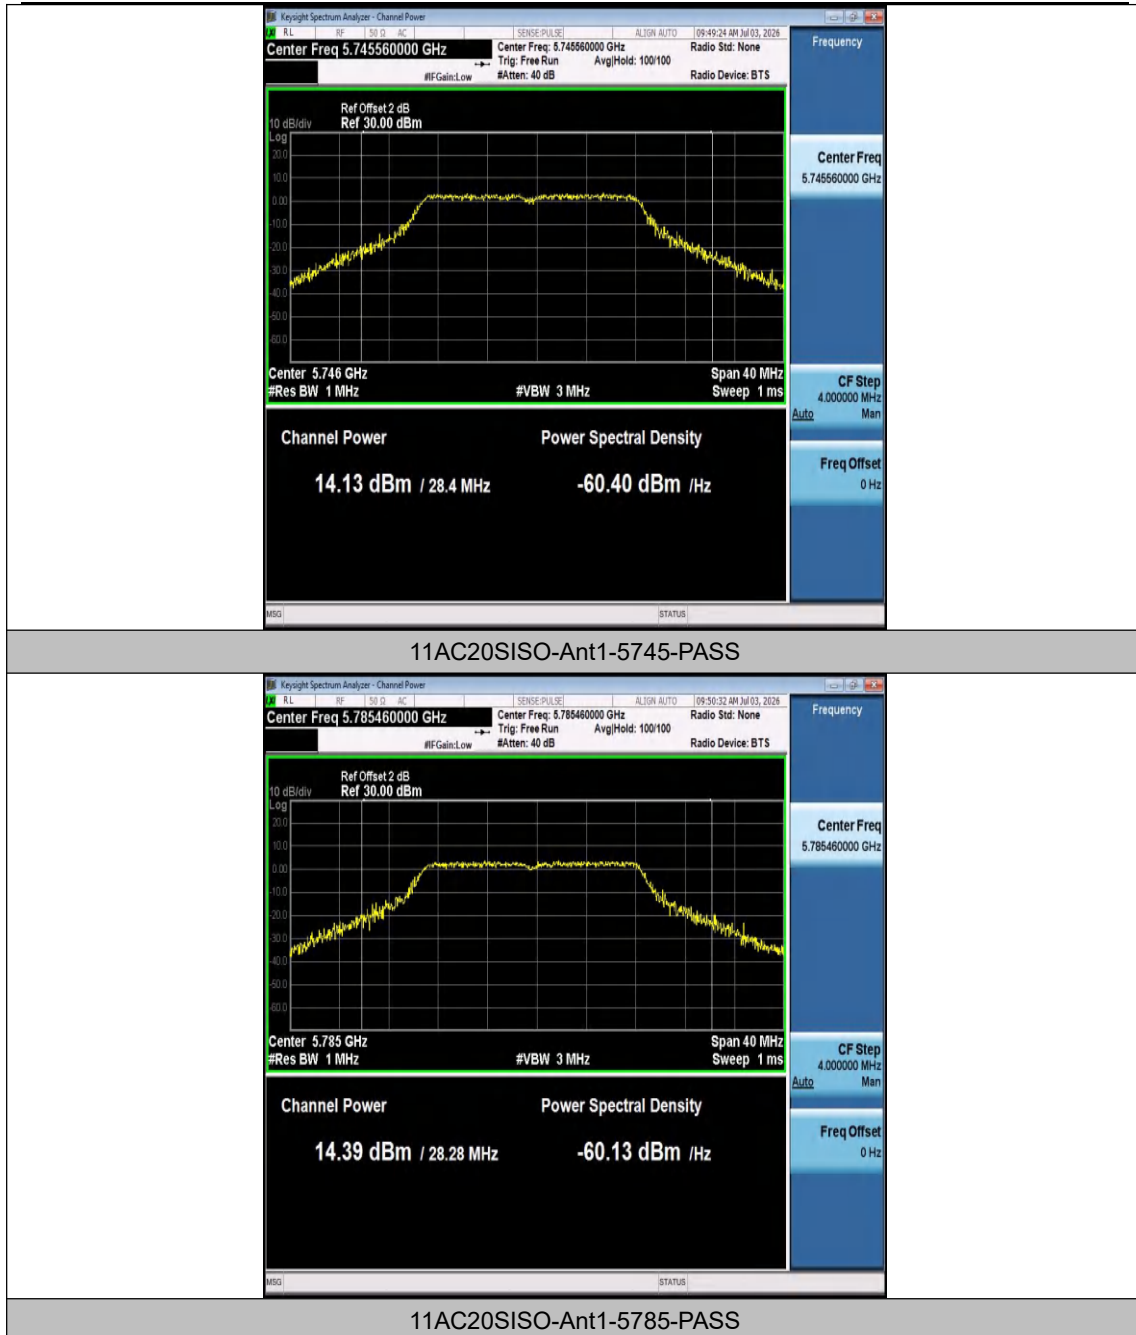


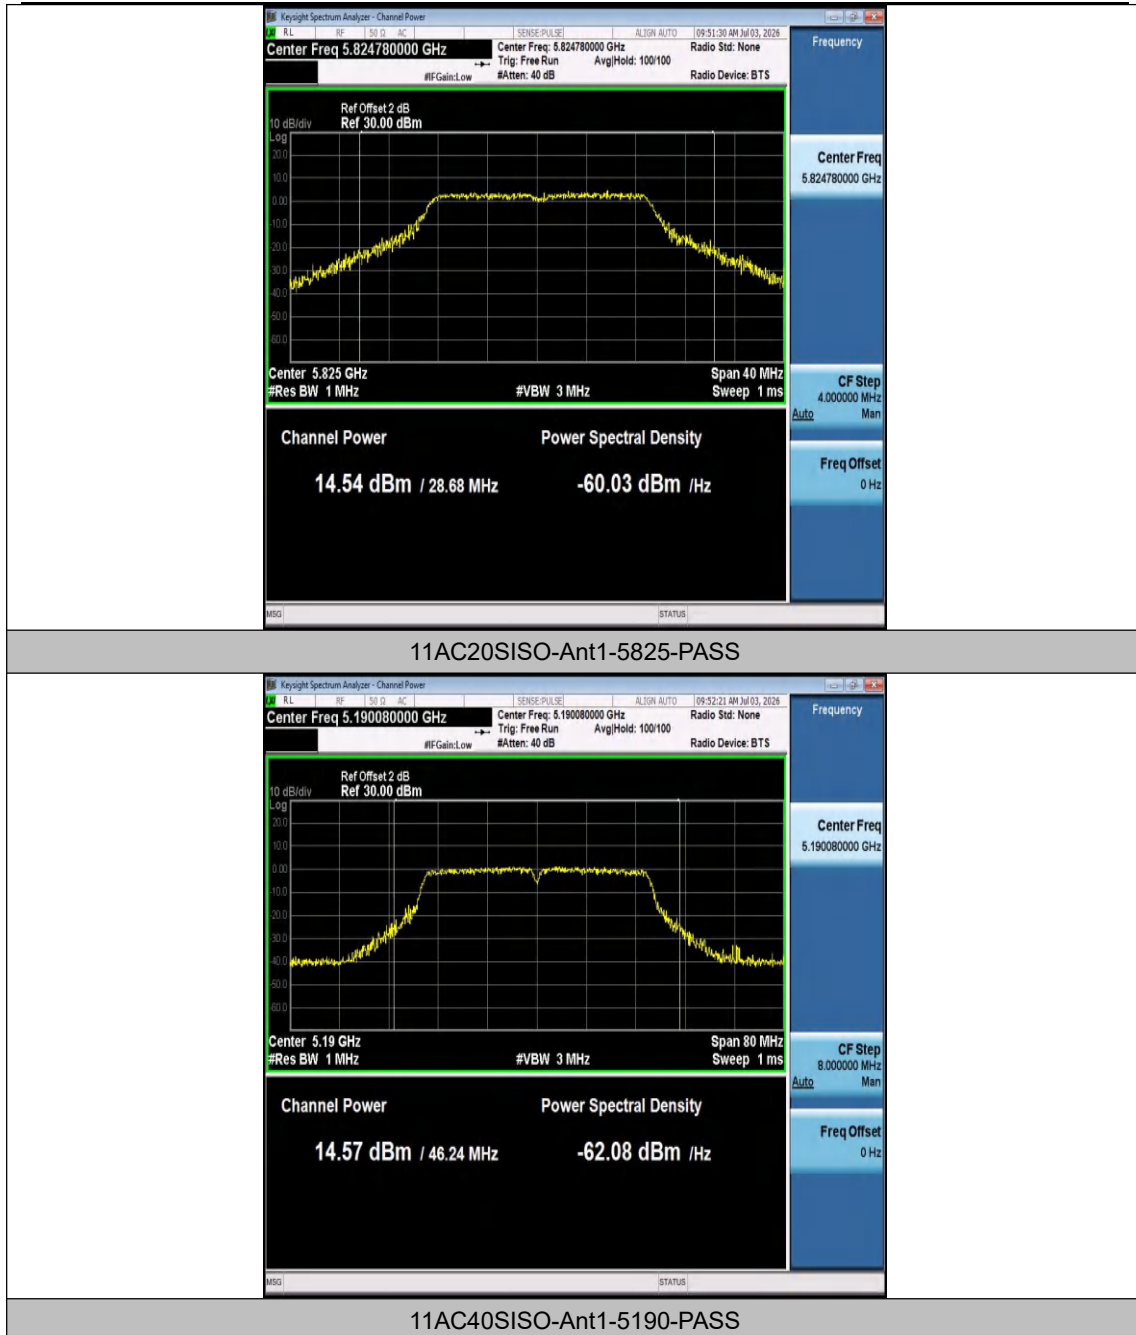

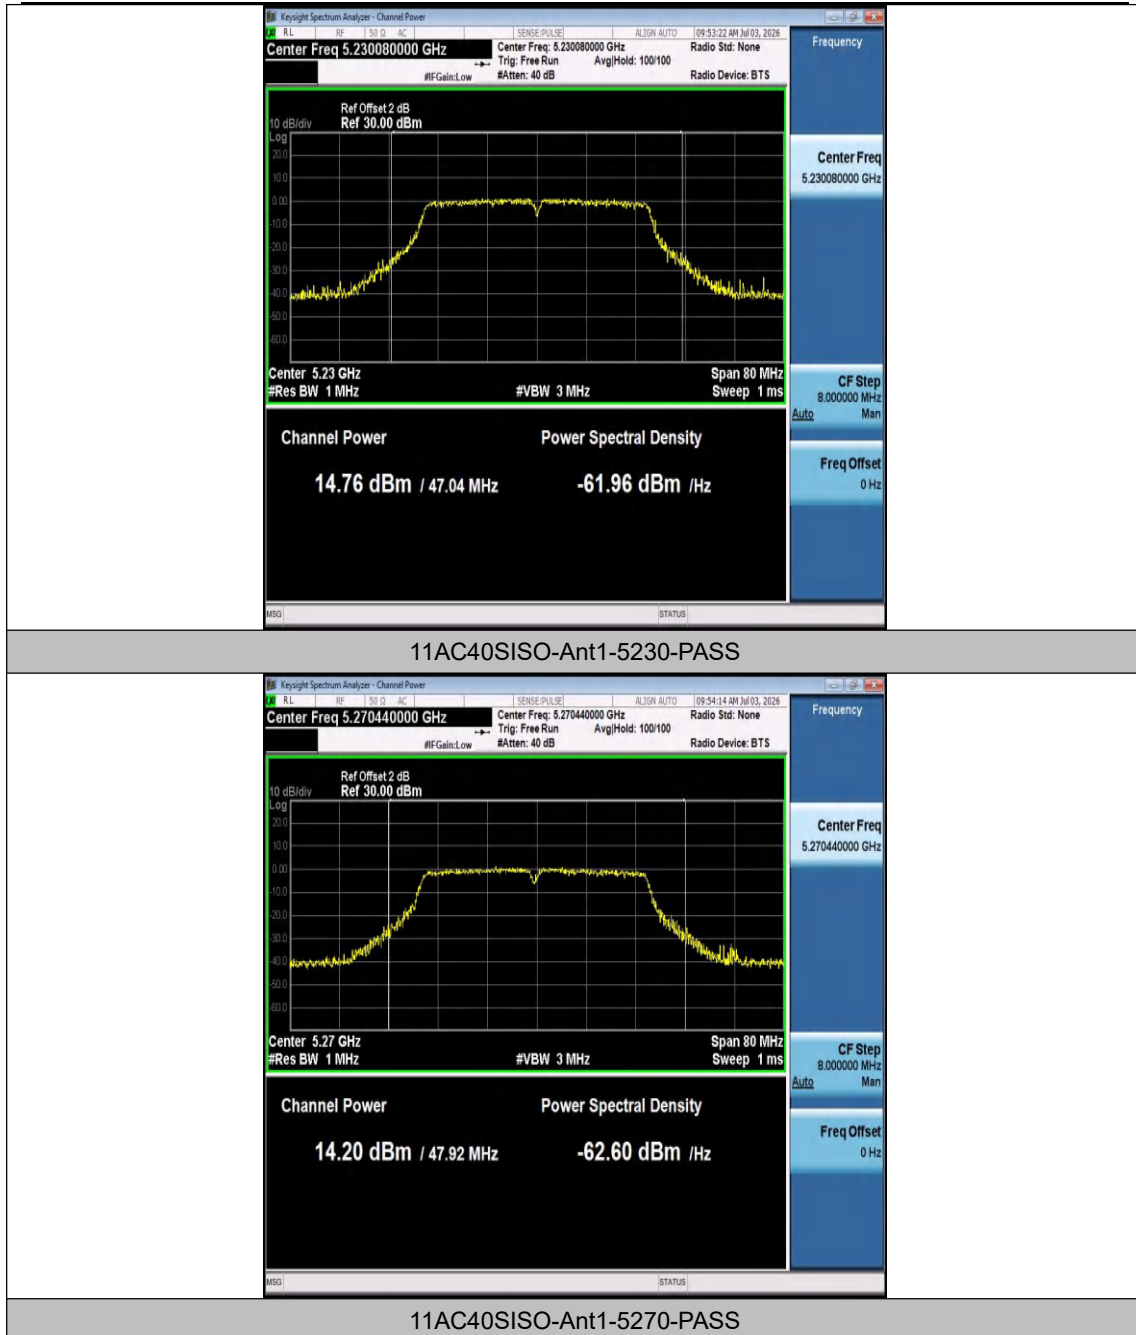

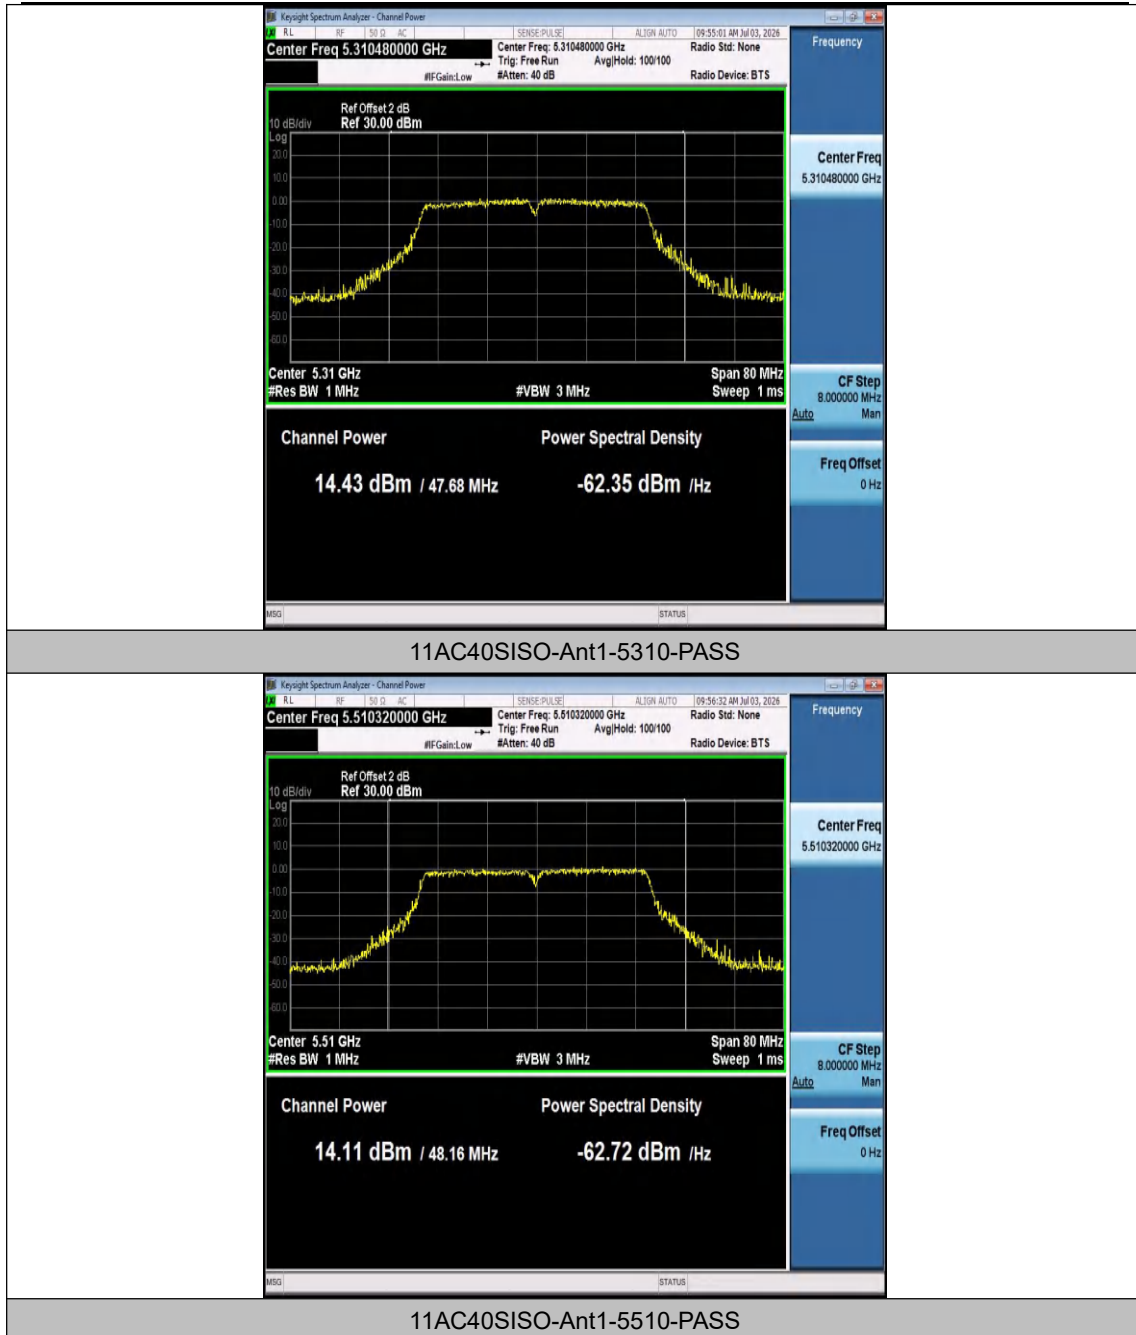

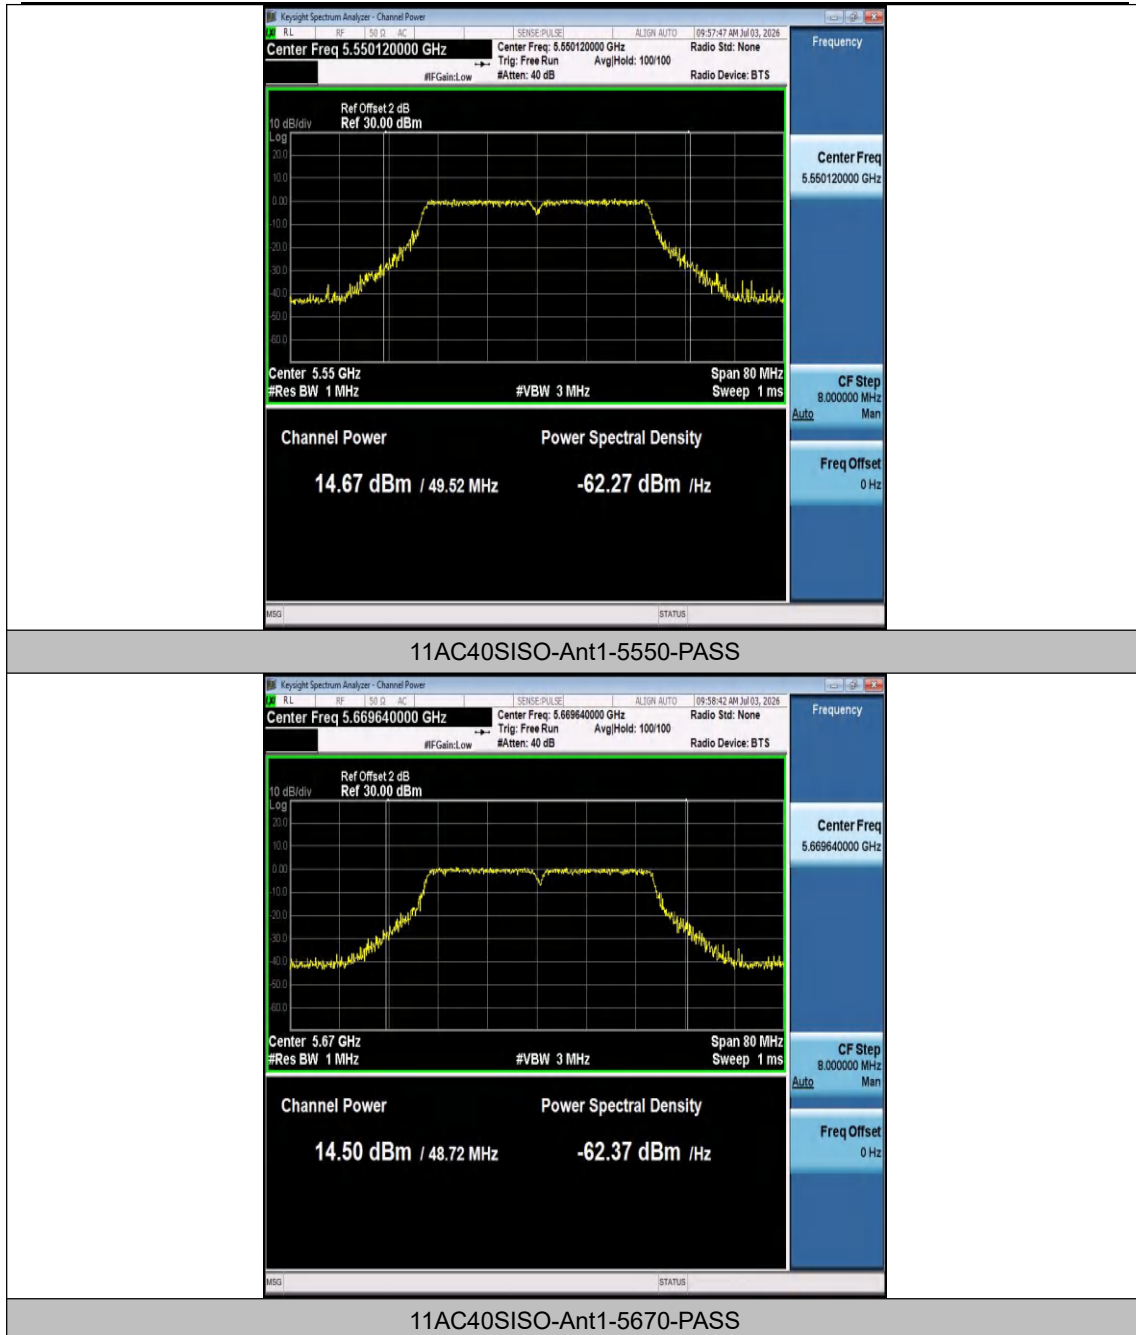

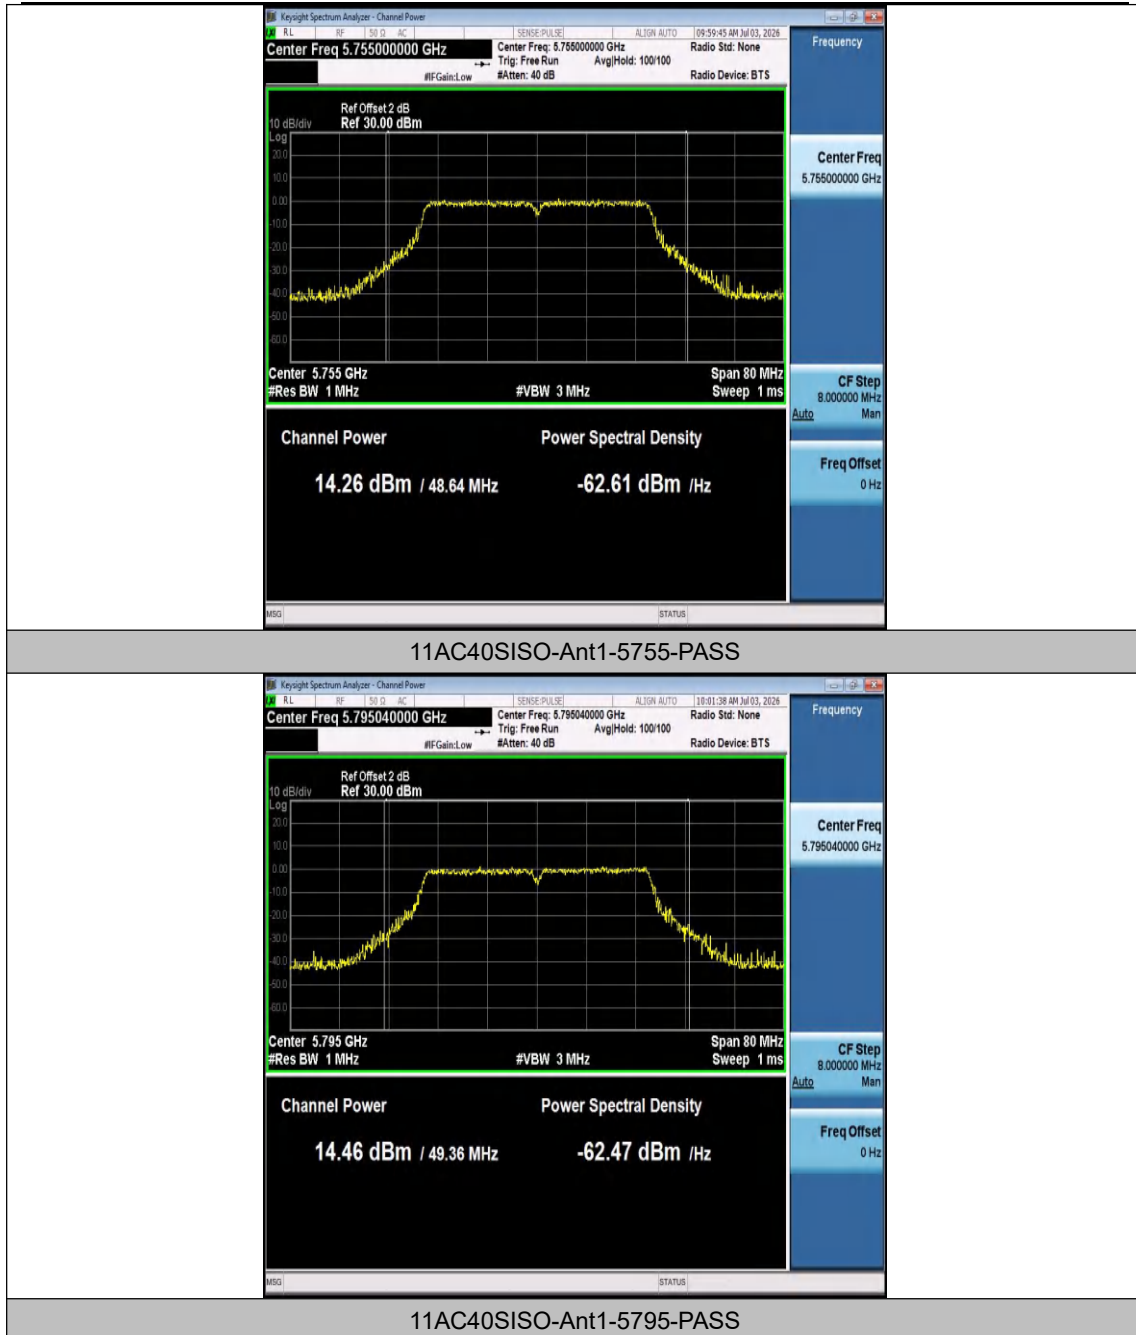

**Shenzhen Anbotek Compliance Laboratory Limited**

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

