



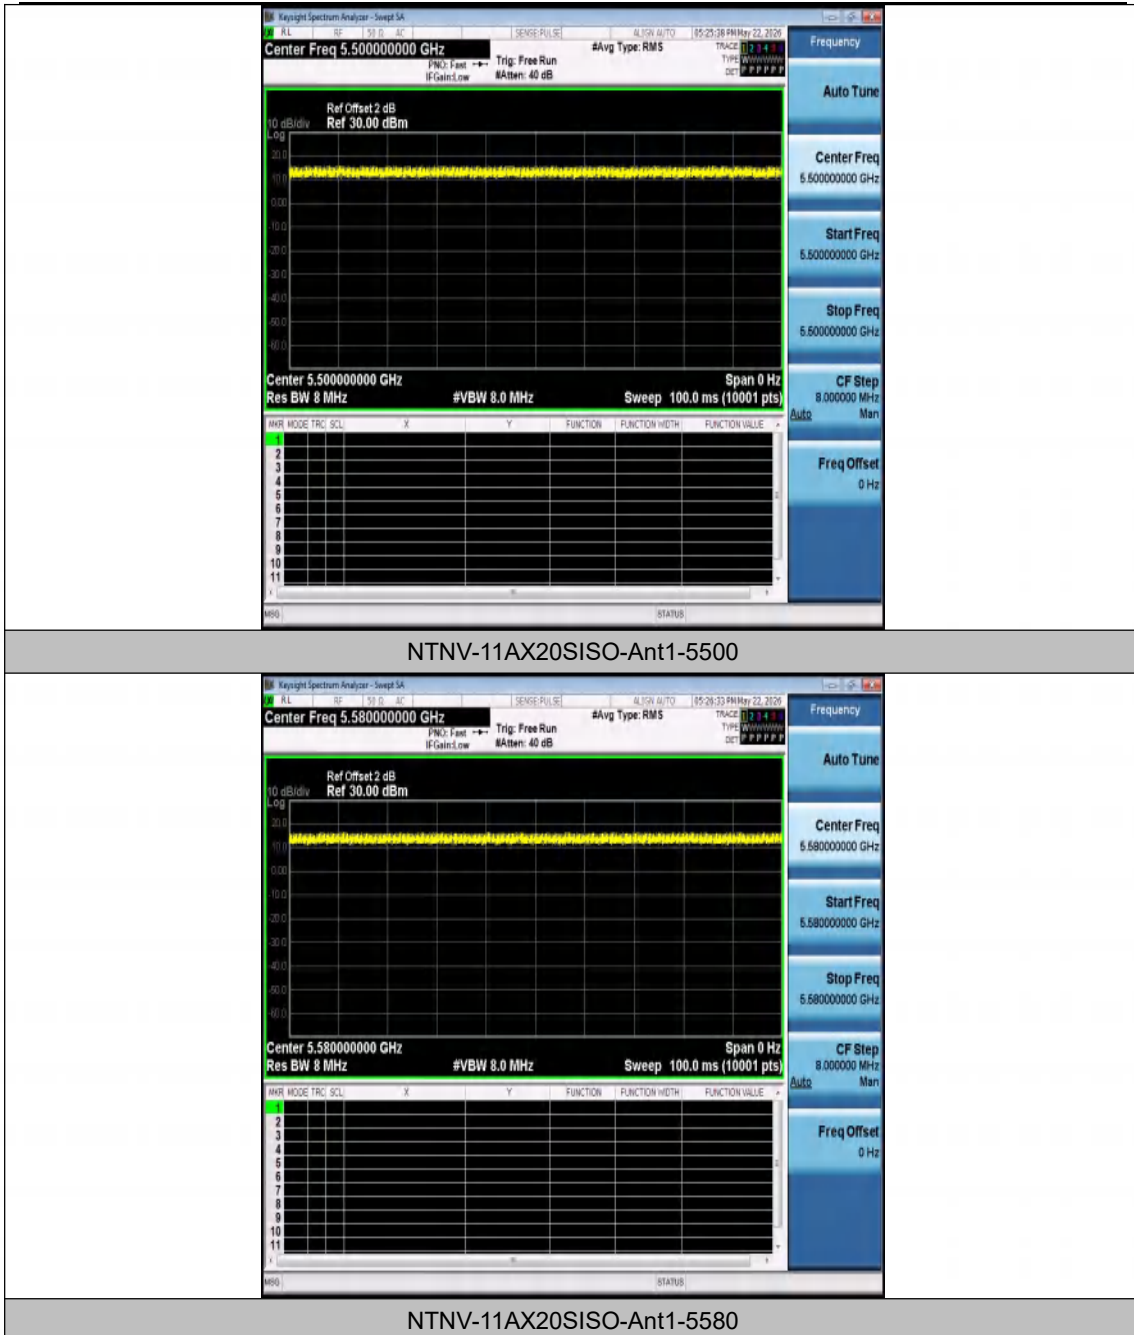

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

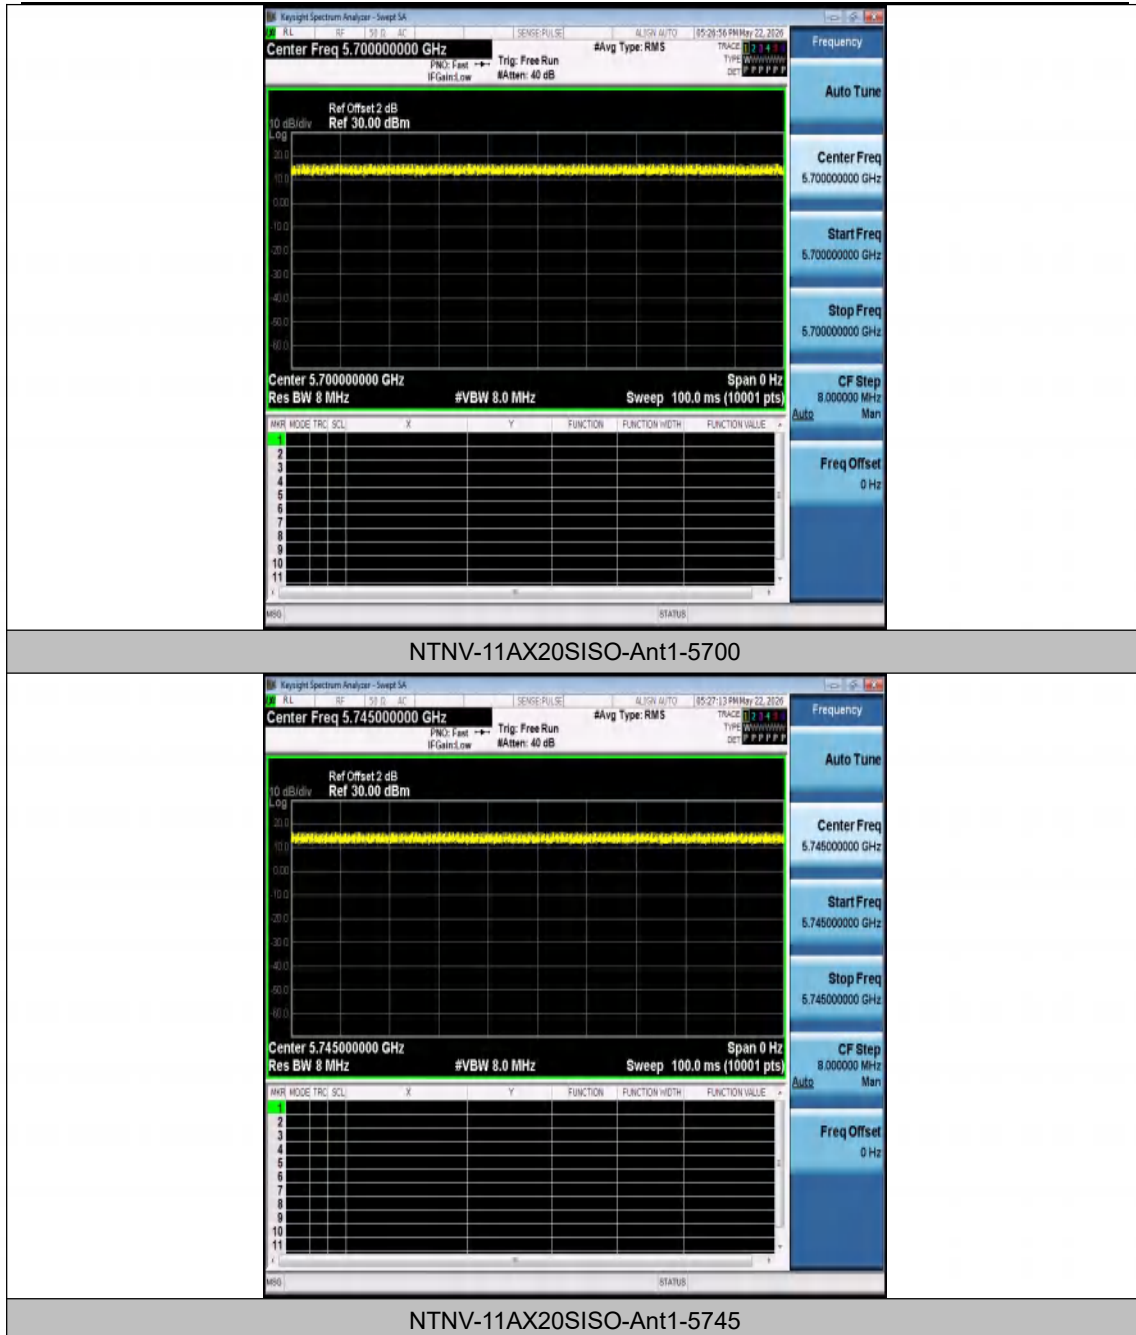

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

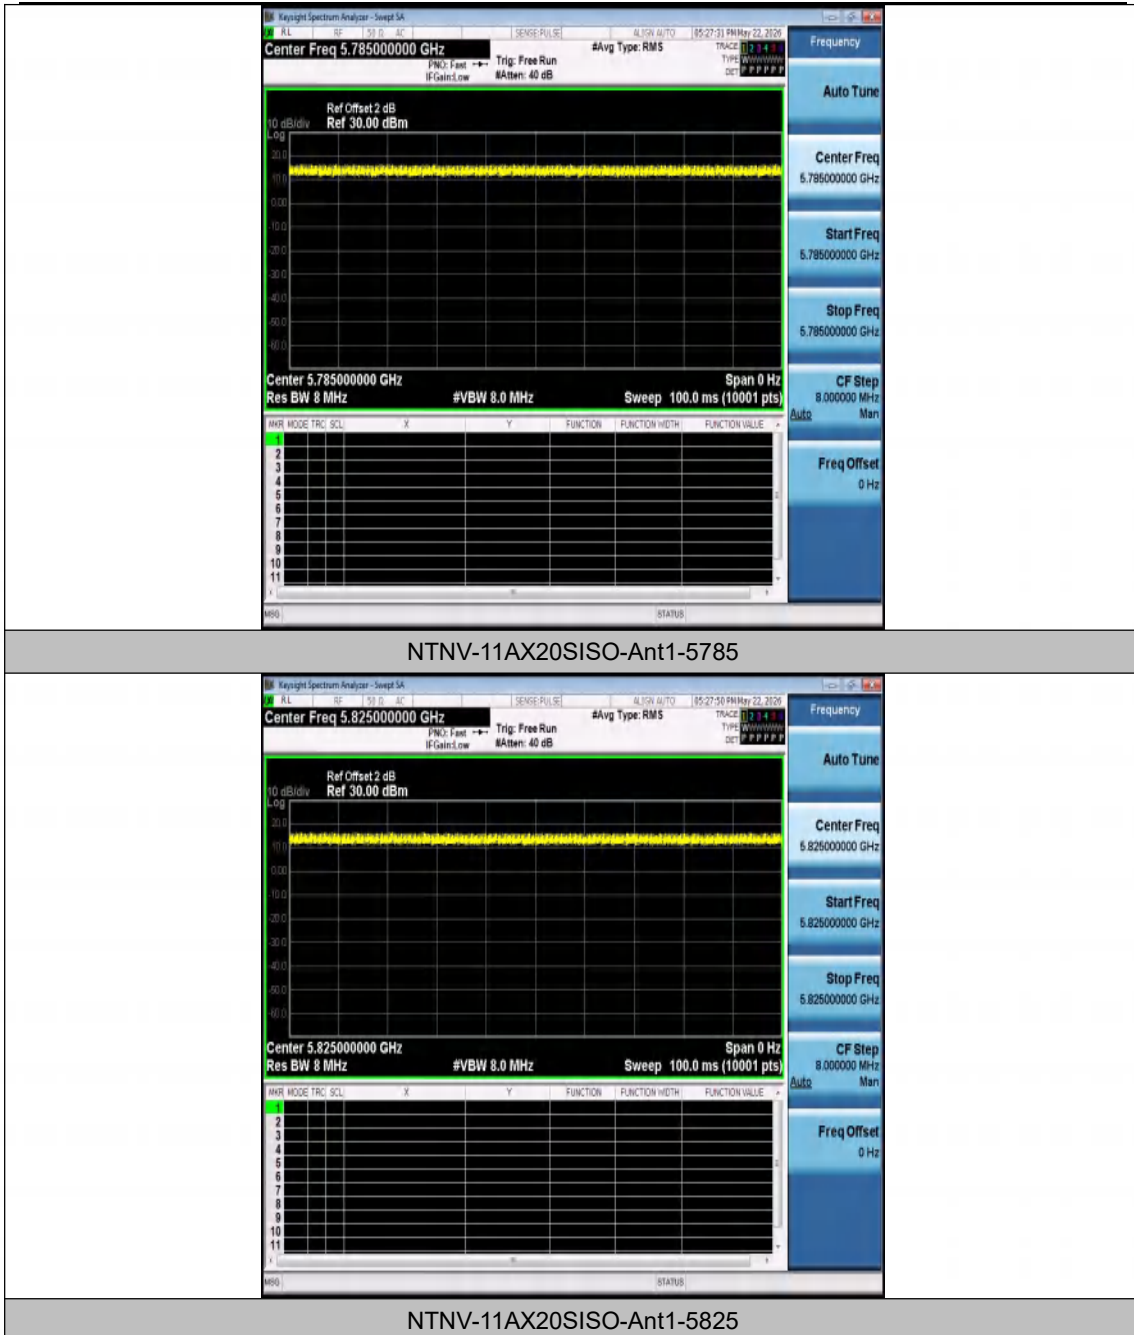

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

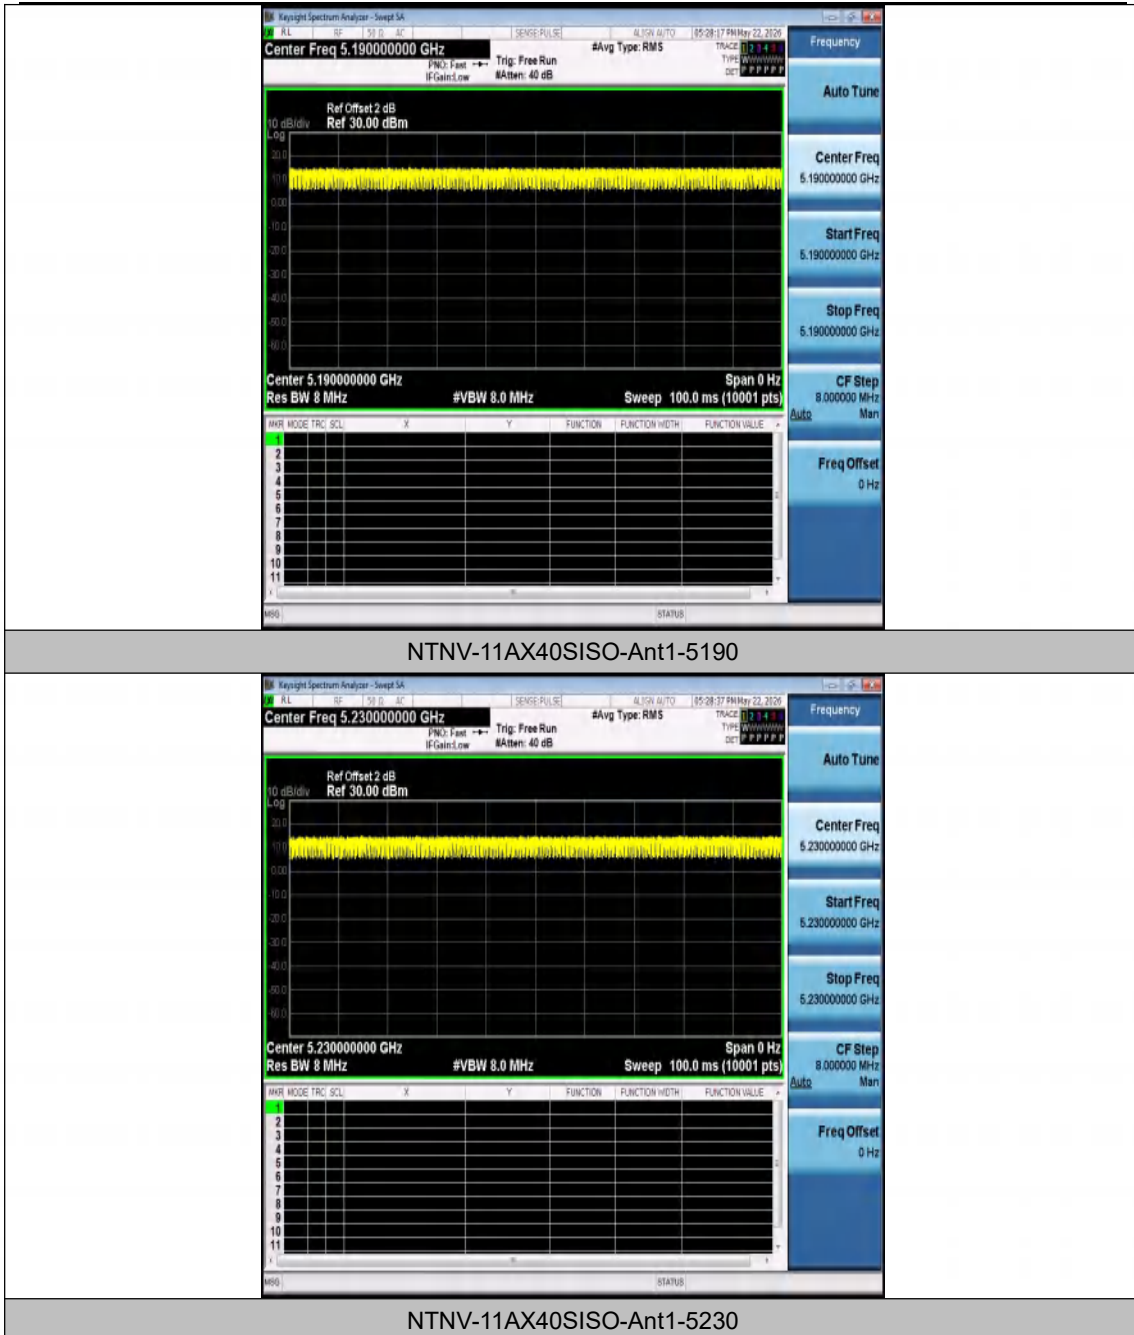

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

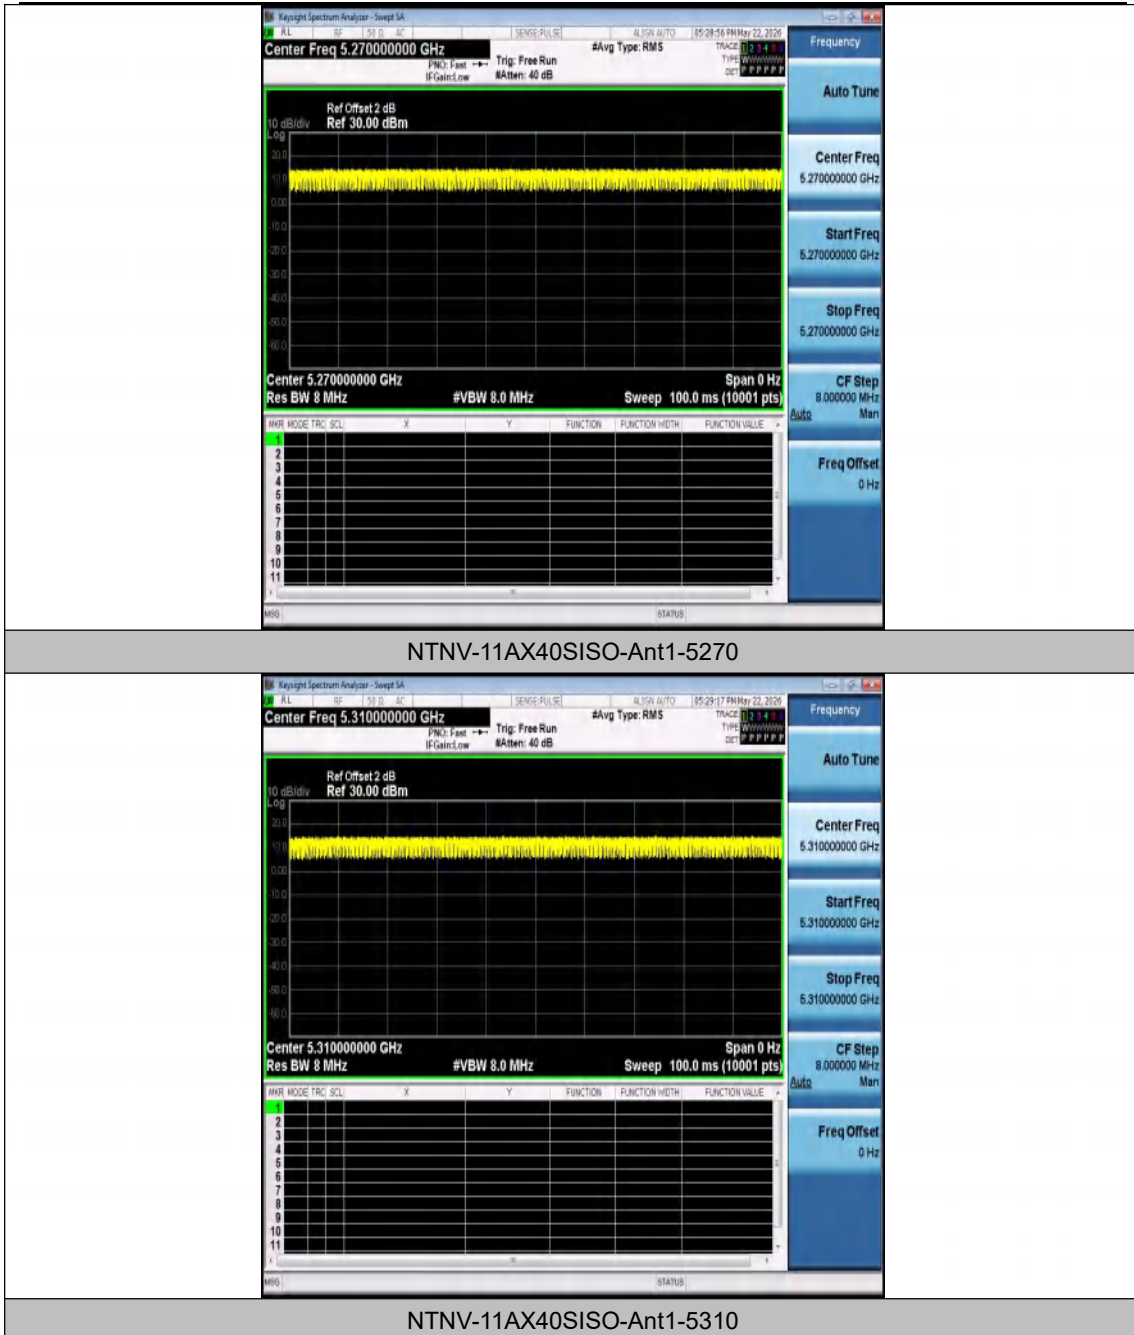

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

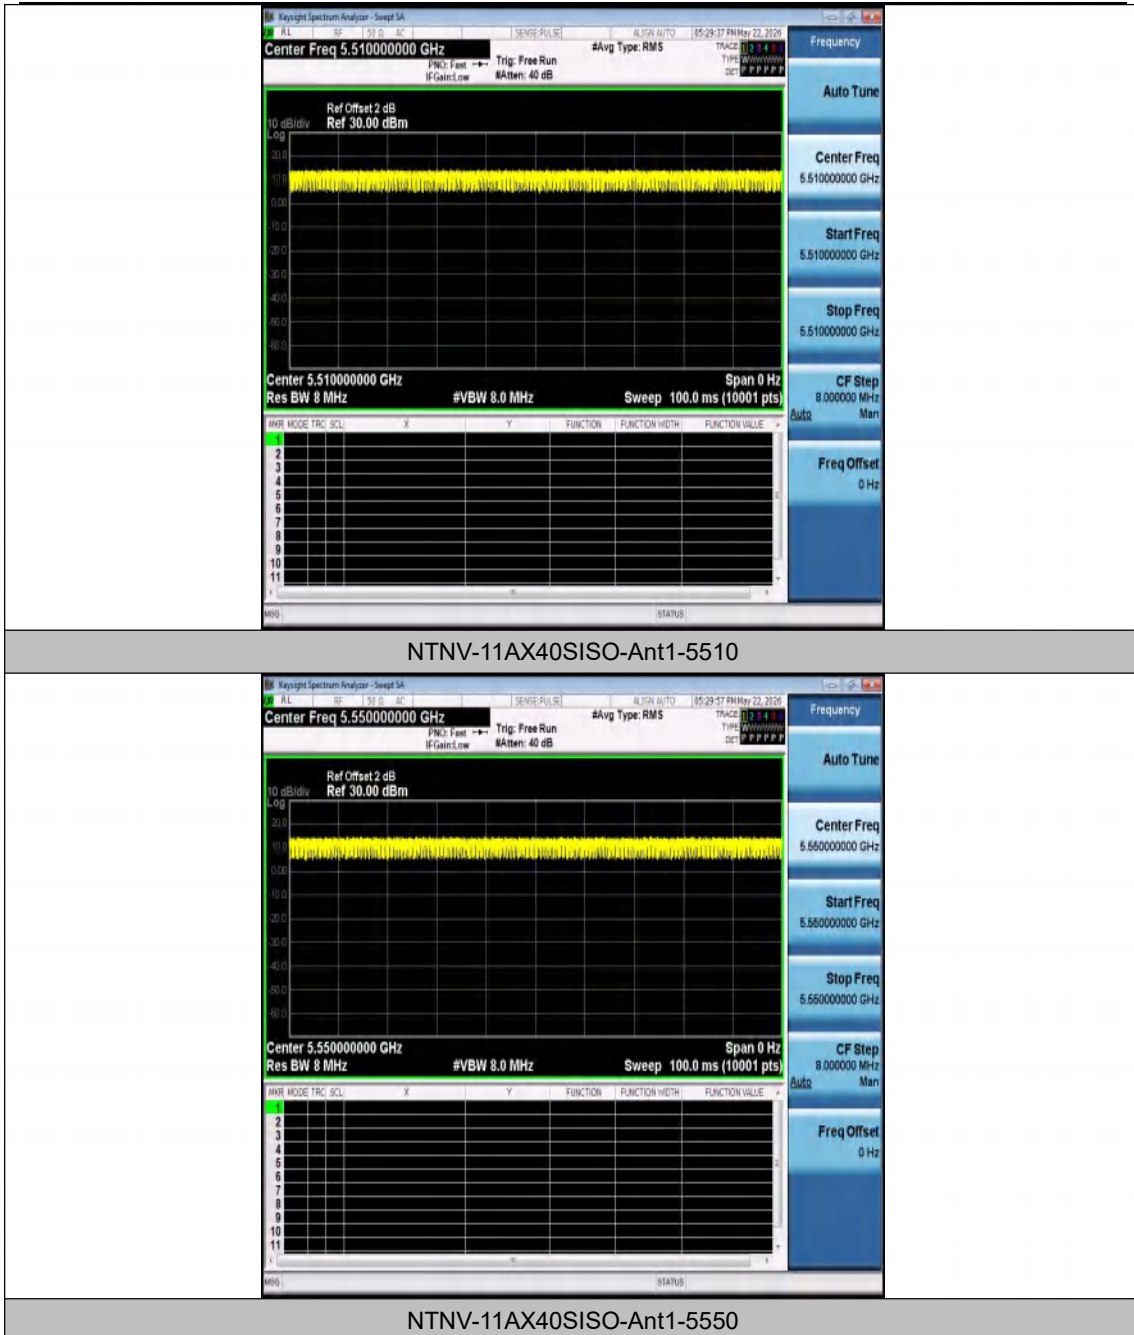



Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

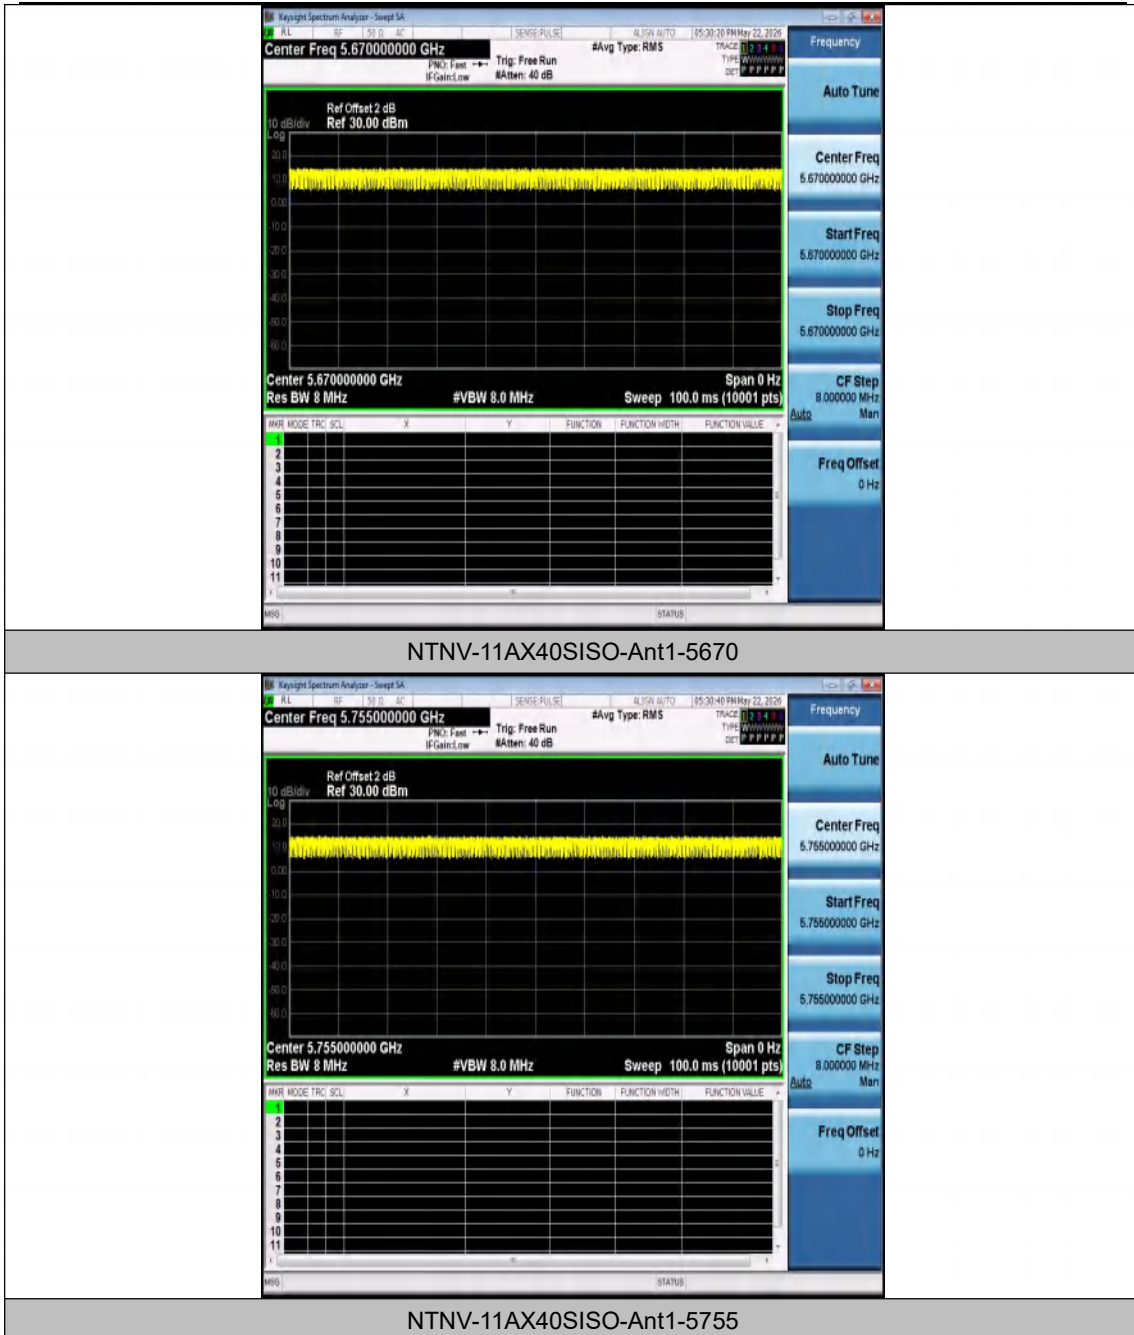

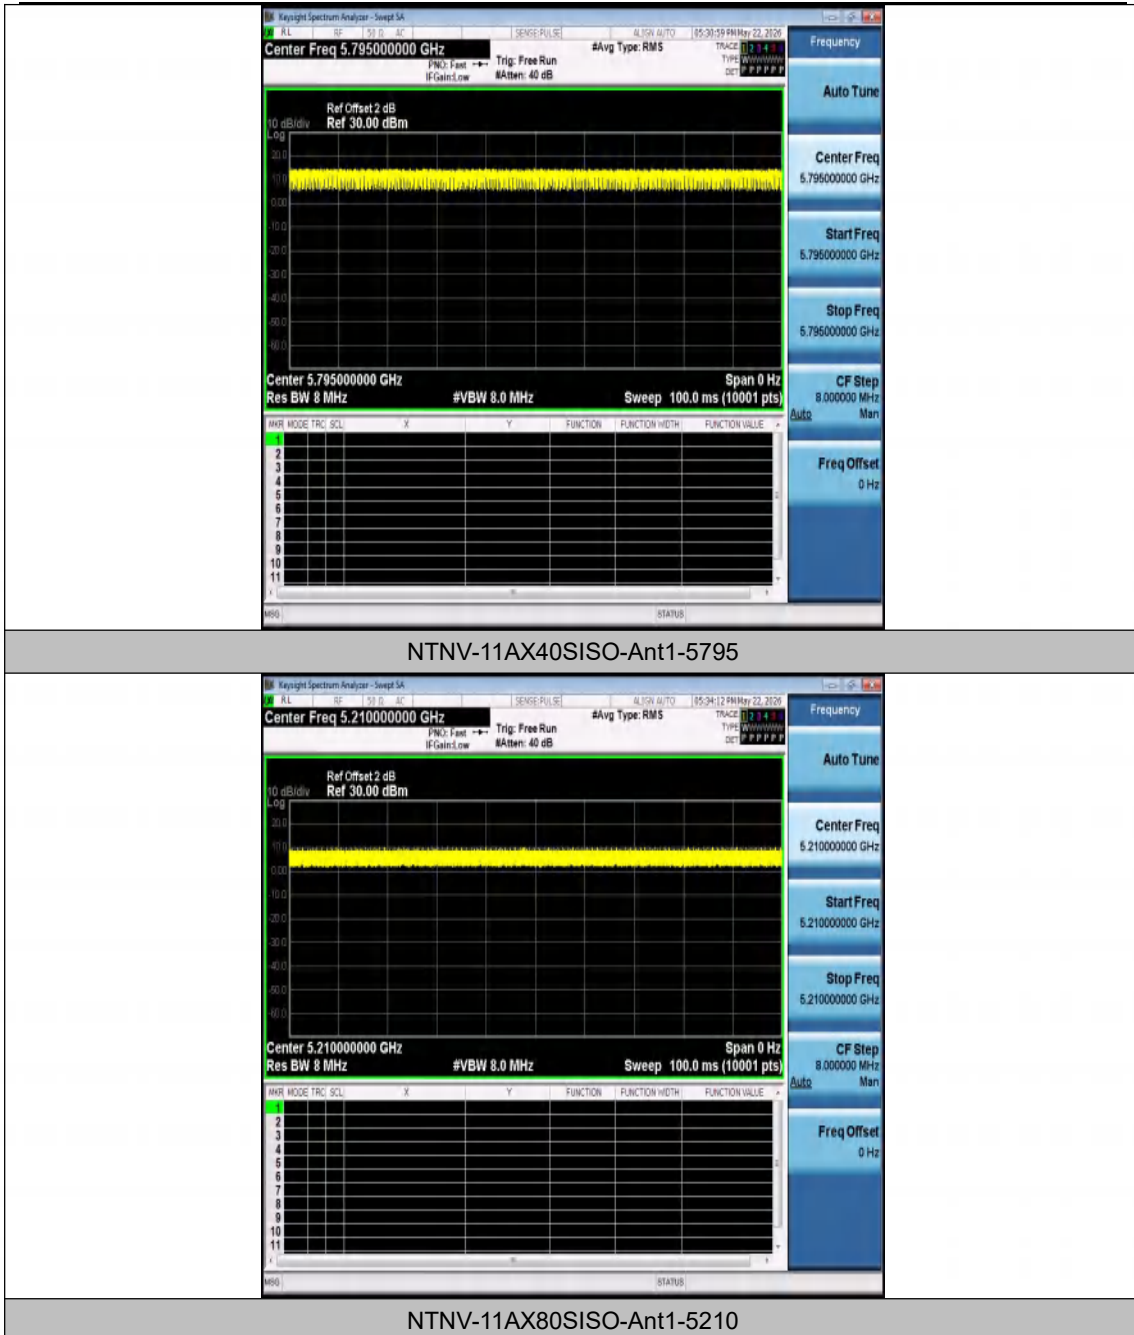

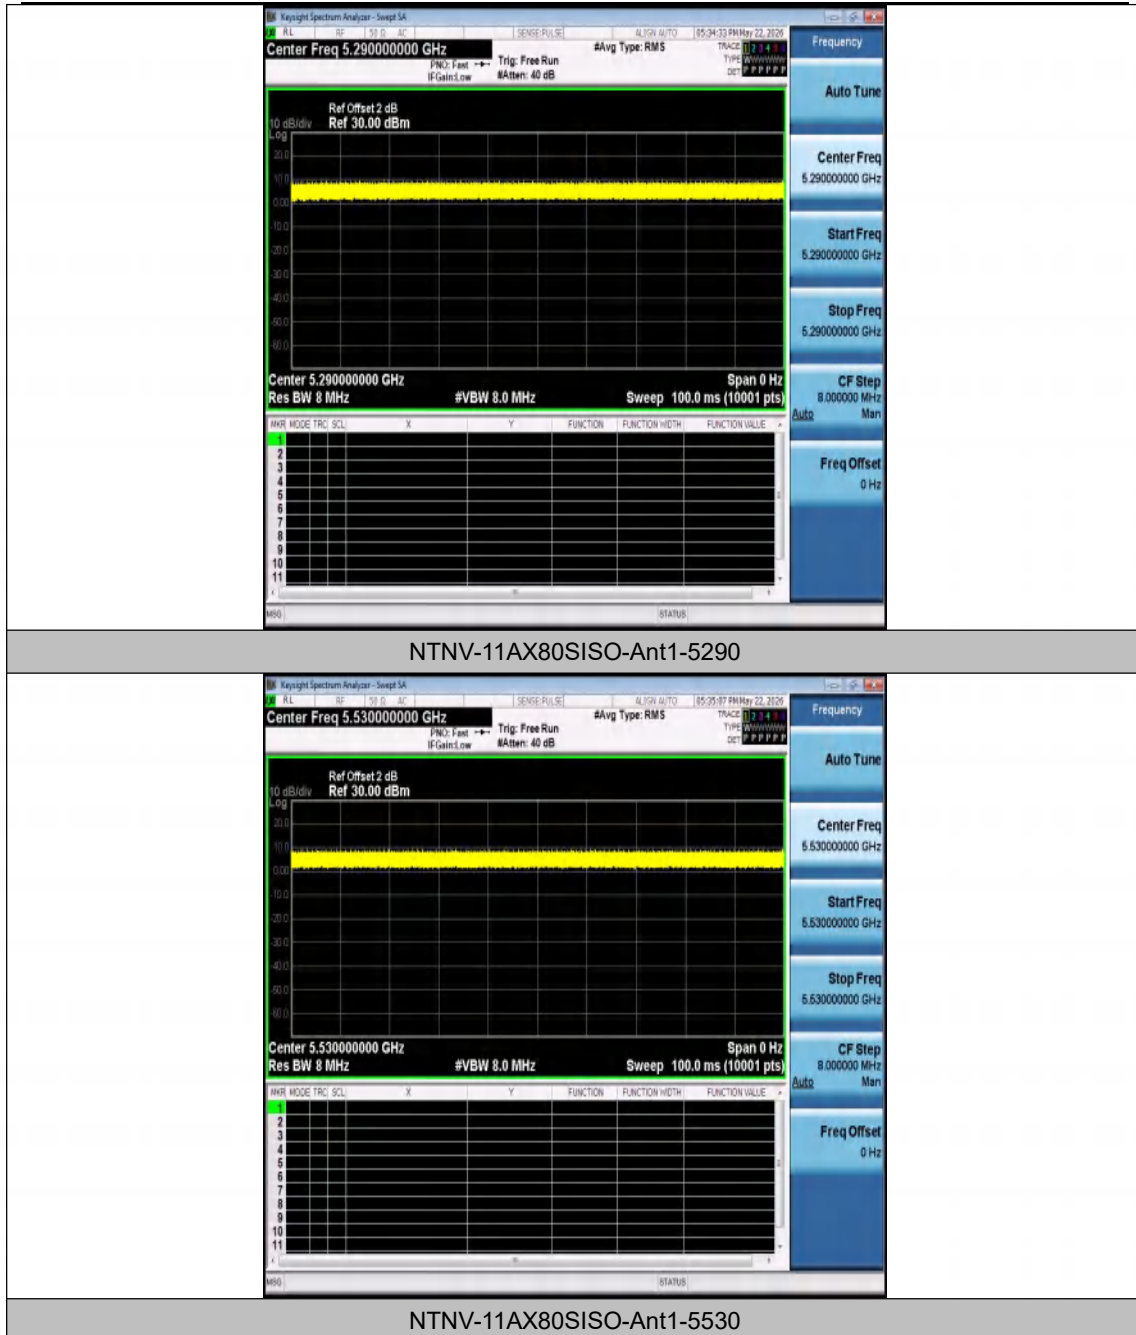

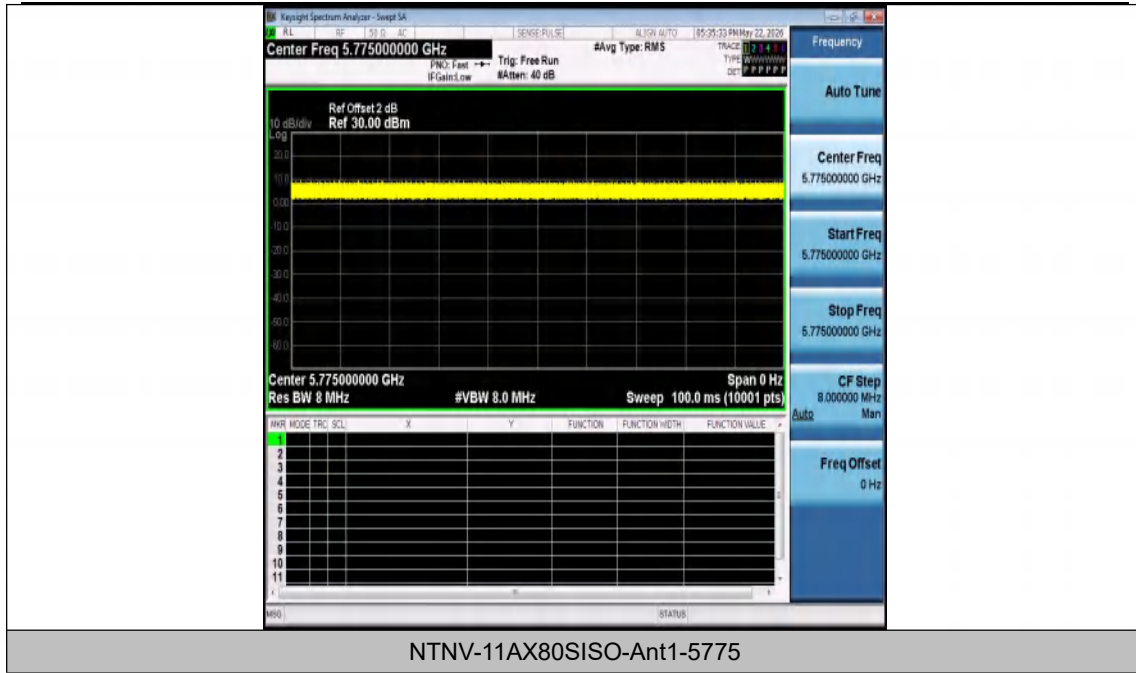

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix C: Maximum Conducted Output Power

Test Result Channel Power

Test Mode	Antenna	Frequency[MHz]	Result [dBm]	Limit [dBm]	Verdict
11A	Ant1	5180	13.80	≤23.98	PASS
11A	Ant1	5220	13.67	≤23.98	PASS
11A	Ant1	5240	13.65	≤23.98	PASS
11A	Ant1	5260	13.81	≤23.98	PASS
11A	Ant1	5300	13.97	≤23.98	PASS
11A	Ant1	5320	14.24	≤23.98	PASS
11A	Ant1	5500	14.19	≤23.98	PASS
11A	Ant1	5580	15.11	≤23.98	PASS
11A	Ant1	5700	15.63	≤23.98	PASS
11A	Ant1	5745	15.91	≤30.00	PASS
11A	Ant1	5785	15.55	≤30.00	PASS
11A	Ant1	5825	15.08	≤30.00	PASS
11N20SISO	Ant1	5180	13.52	≤23.98	PASS
11N20SISO	Ant1	5220	13.55	≤23.98	PASS
11N20SISO	Ant1	5240	13.35	≤23.98	PASS
11N20SISO	Ant1	5260	13.30	≤23.98	PASS
11N20SISO	Ant1	5300	13.99	≤23.98	PASS
11N20SISO	Ant1	5320	13.99	≤23.98	PASS
11N20SISO	Ant1	5500	14.13	≤23.98	PASS
11N20SISO	Ant1	5580	15.12	≤23.98	PASS
11N20SISO	Ant1	5700	15.61	≤23.98	PASS
11N20SISO	Ant1	5745	15.93	≤30.00	PASS
11N20SISO	Ant1	5785	15.55	≤30.00	PASS
11N20SISO	Ant1	5825	14.99	≤30.00	PASS
11N40SISO	Ant1	5190	13.55	≤23.98	PASS
11N40SISO	Ant1	5230	13.36	≤23.98	PASS
11N40SISO	Ant1	5270	13.52	≤23.98	PASS
11N40SISO	Ant1	5310	14.00	≤23.98	PASS
11N40SISO	Ant1	5510	14.25	≤23.98	PASS
11N40SISO	Ant1	5550	14.71	≤23.98	PASS
11N40SISO	Ant1	5670	15.71	≤23.98	PASS
11N40SISO	Ant1	5755	16.34	≤30.00	PASS
11N40SISO	Ant1	5795	15.70	≤30.00	PASS
11AC20SISO	Ant1	5180	13.99	≤23.98	PASS
11AC20SISO	Ant1	5220	13.85	≤23.98	PASS
11AC20SISO	Ant1	5240	13.57	≤23.98	PASS
11AC20SISO	Ant1	5260	13.57	≤23.98	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

11AC20SISO	Ant1	5300	13.99	≤23.98	PASS
11AC20SISO	Ant1	5320	14.25	≤23.98	PASS
11AC20SISO	Ant1	5500	14.43	≤23.98	PASS
11AC20SISO	Ant1	5580	15.38	≤23.98	PASS
11AC20SISO	Ant1	5700	15.76	≤23.98	PASS
11AC20SISO	Ant1	5745	16.04	≤30.00	PASS
11AC20SISO	Ant1	5785	15.81	≤30.00	PASS
11AC20SISO	Ant1	5825	15.37	≤30.00	PASS
11AC40SISO	Ant1	5190	13.86	≤23.98	PASS
11AC40SISO	Ant1	5230	13.65	≤23.98	PASS
11AC40SISO	Ant1	5270	13.86	≤23.98	PASS
11AC40SISO	Ant1	5310	14.25	≤23.98	PASS
11AC40SISO	Ant1	5510	14.58	≤23.98	PASS
11AC40SISO	Ant1	5550	14.91	≤23.98	PASS
11AC40SISO	Ant1	5670	15.82	≤23.98	PASS
11AC40SISO	Ant1	5755	16.01	≤30.00	PASS
11AC40SISO	Ant1	5795	15.59	≤30.00	PASS
11AC80SISO	Ant1	5210	13.83	≤23.98	PASS
11AC80SISO	Ant1	5290	14.17	≤23.98	PASS
11AC80SISO	Ant1	5530	14.71	≤23.98	PASS
11AC80SISO	Ant1	5775	15.65	≤30.00	PASS
11AX20SISO	Ant1	5180	14.61	≤23.98	PASS
11AX20SISO	Ant1	5220	14.54	≤23.98	PASS
11AX20SISO	Ant1	5240	14.44	≤23.98	PASS
11AX20SISO	Ant1	5260	14.32	≤23.98	PASS
11AX20SISO	Ant1	5300	14.75	≤23.98	PASS
11AX20SISO	Ant1	5320	15.02	≤23.98	PASS
11AX20SISO	Ant1	5500	15.27	≤23.98	PASS
11AX20SISO	Ant1	5580	16.17	≤23.98	PASS
11AX20SISO	Ant1	5700	16.63	≤23.98	PASS
11AX20SISO	Ant1	5745	16.90	≤30.00	PASS
11AX20SISO	Ant1	5785	16.50	≤30.00	PASS
11AX20SISO	Ant1	5825	16.13	≤30.00	PASS
11AX40SISO	Ant1	5190	14.59	≤23.98	PASS
11AX40SISO	Ant1	5230	14.24	≤23.98	PASS
11AX40SISO	Ant1	5270	14.60	≤23.98	PASS
11AX40SISO	Ant1	5310	14.95	≤23.98	PASS
11AX40SISO	Ant1	5510	15.37	≤23.98	PASS
11AX40SISO	Ant1	5550	15.68	≤23.98	PASS
11AX40SISO	Ant1	5670	16.55	≤23.98	PASS
11AX40SISO	Ant1	5755	16.65	≤30.00	PASS
11AX40SISO	Ant1	5795	16.19	≤30.00	PASS

Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

11AX80SISO	Ant1	5210	14.40	≤23.98	PASS
11AX80SISO	Ant1	5290	14.78	≤23.98	PASS
11AX80SISO	Ant1	5530	15.06	≤23.98	PASS
11AX80SISO	Ant1	5775	16.36	≤30.00	PASS


Note: 1.The cable loss are compensated in the graph.

Test Graphs Channel Power

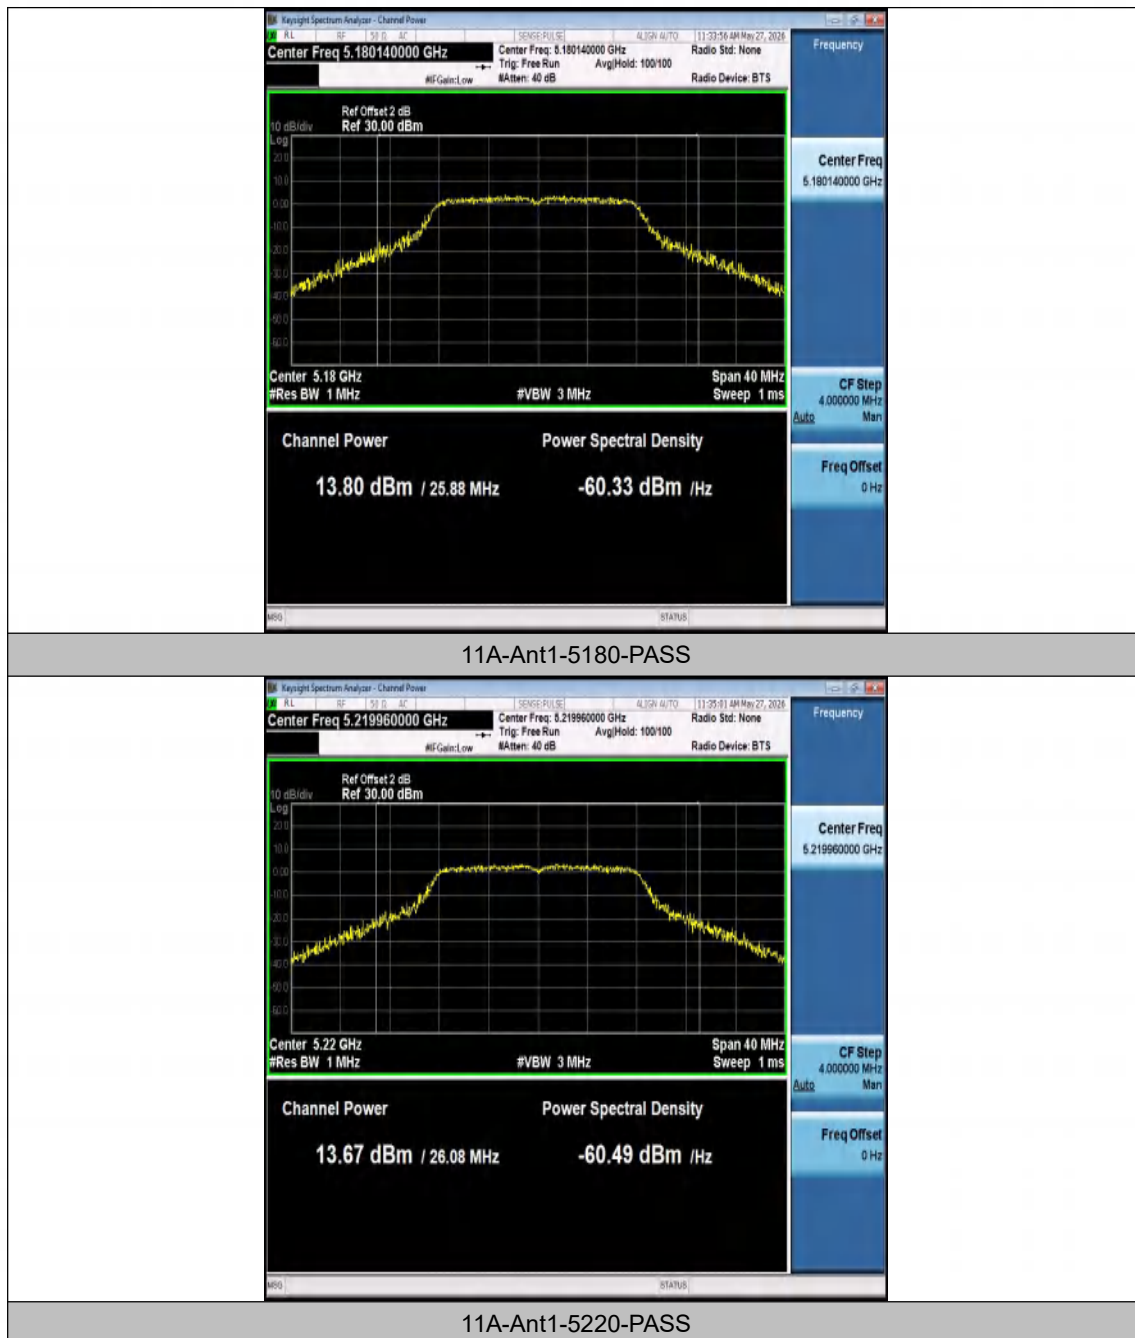

11A-Ant1-5180-PASS


11A-Ant1-5220-PASS

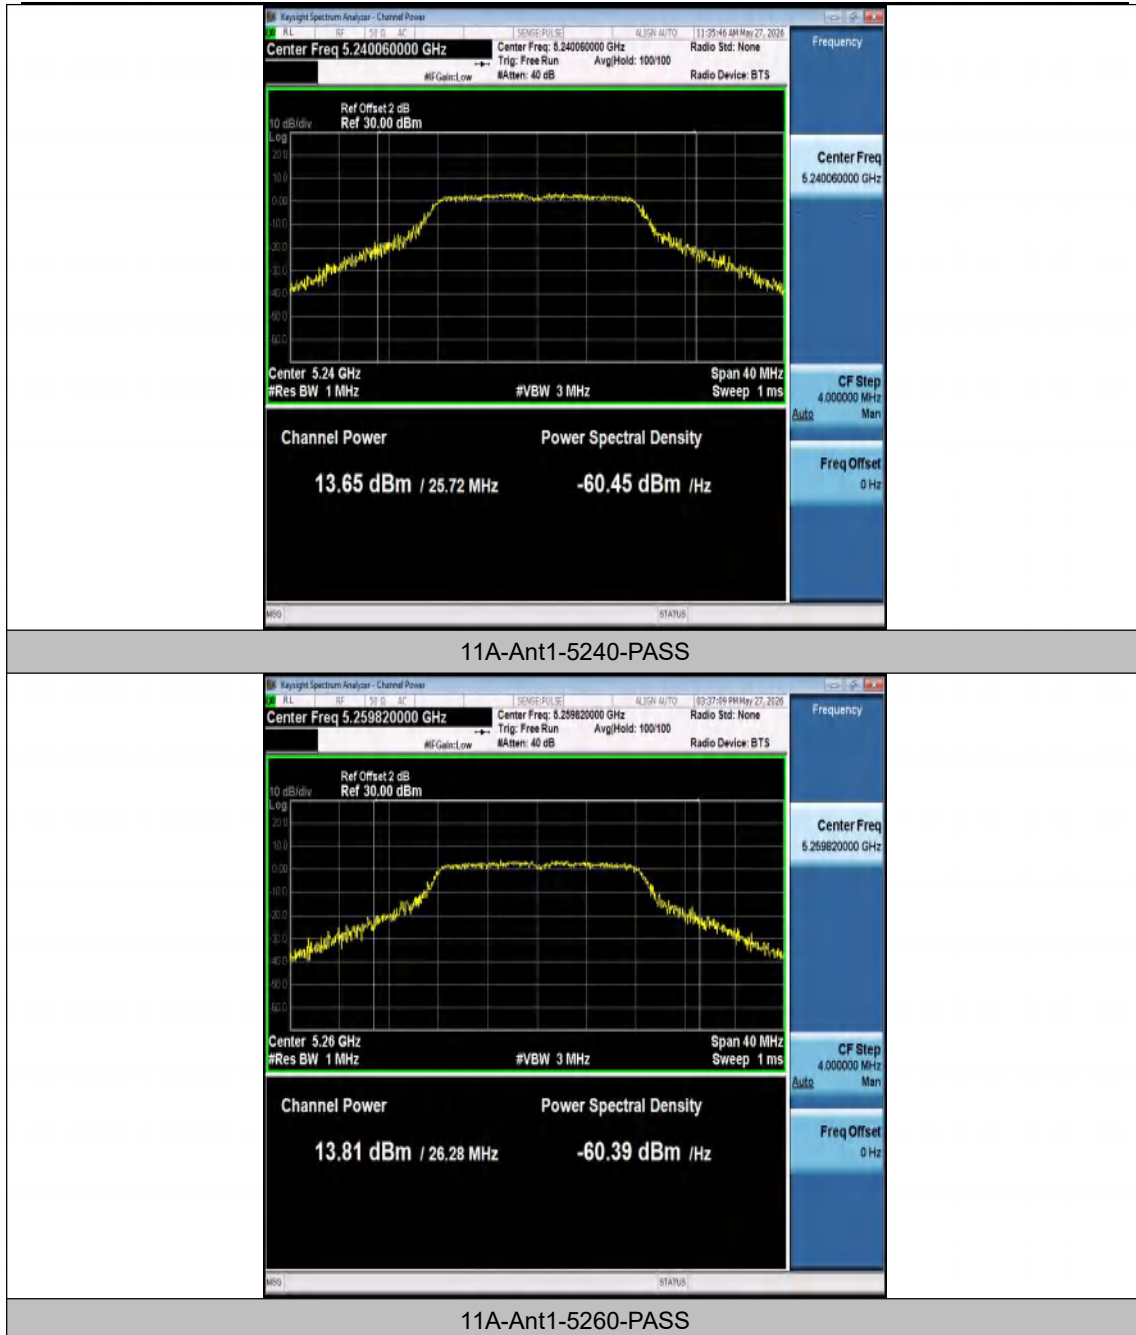


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

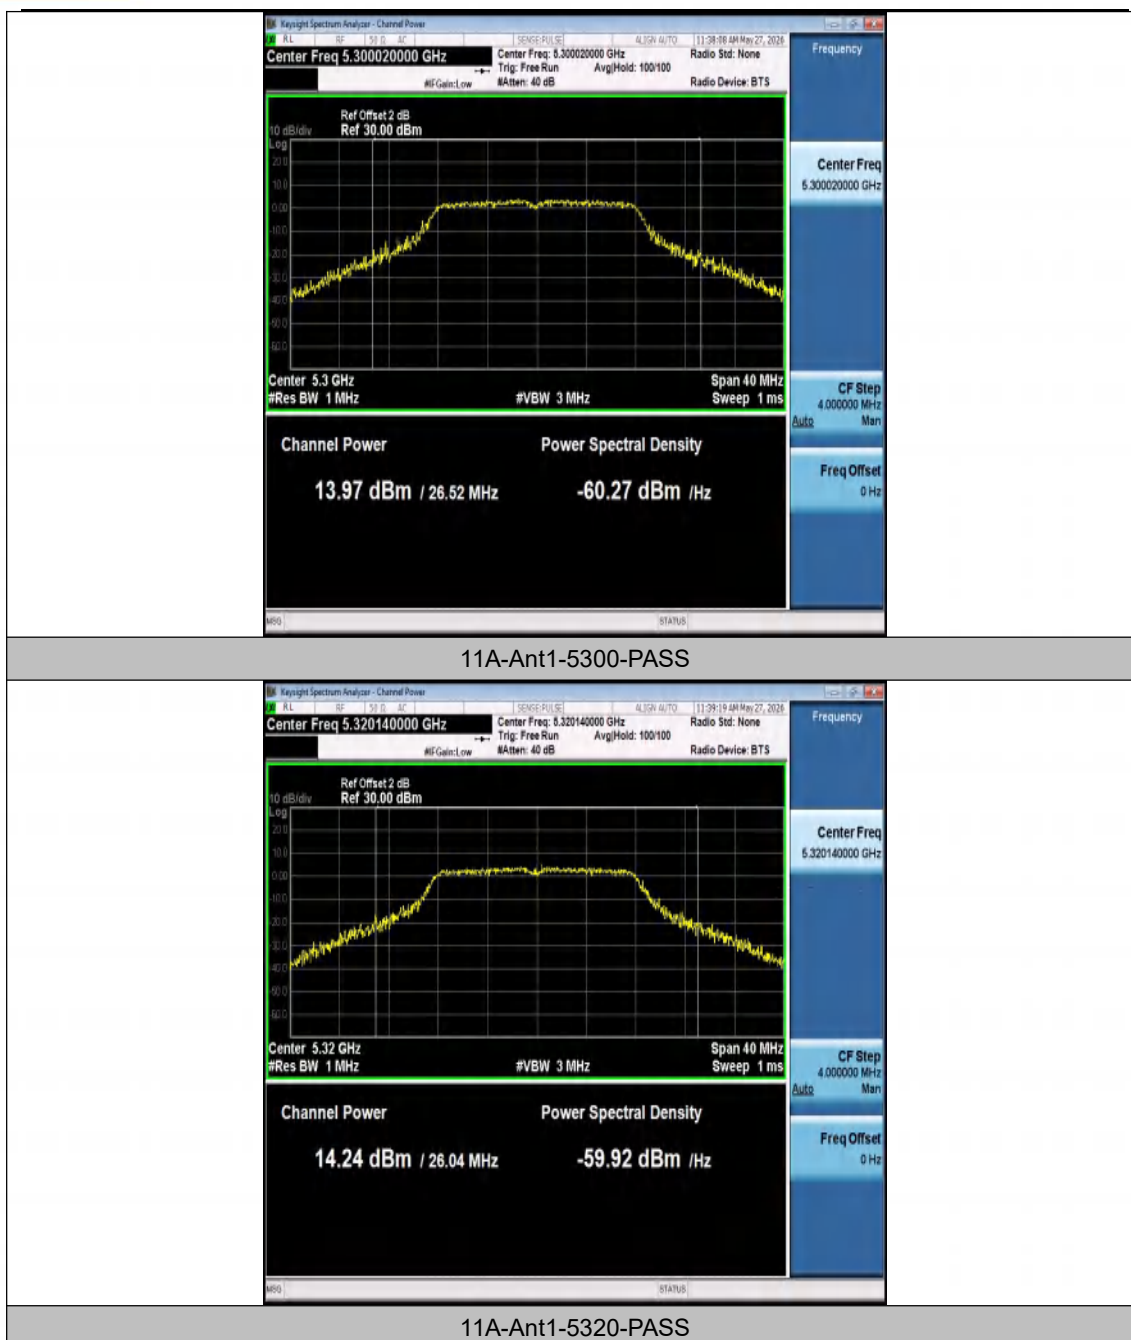

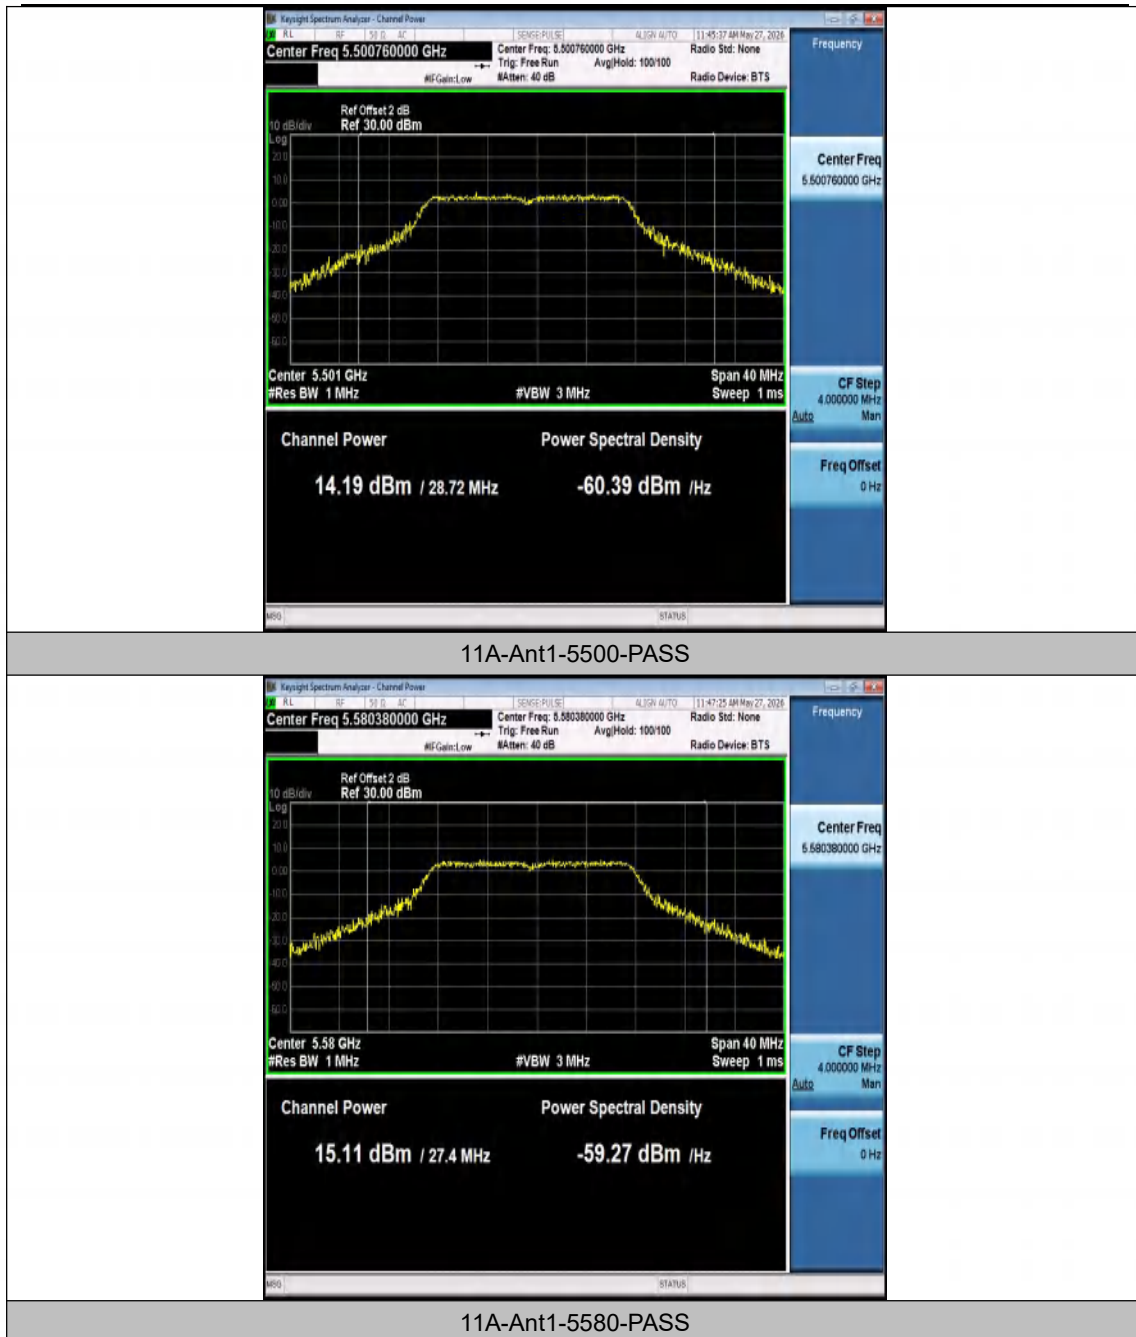





Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com





Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

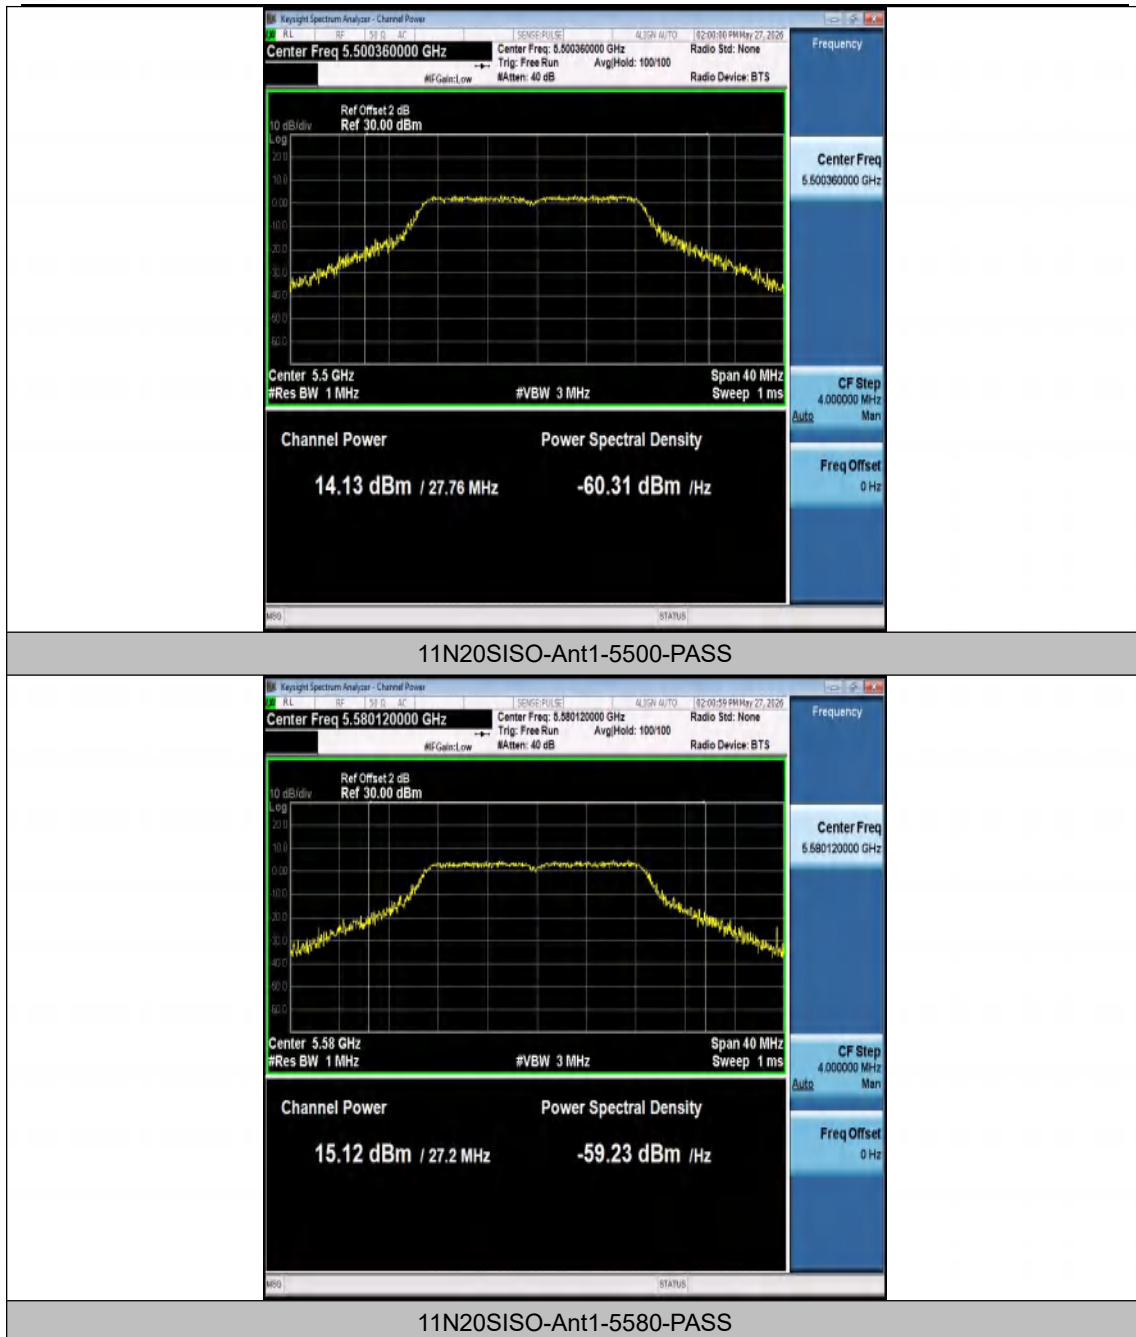




Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

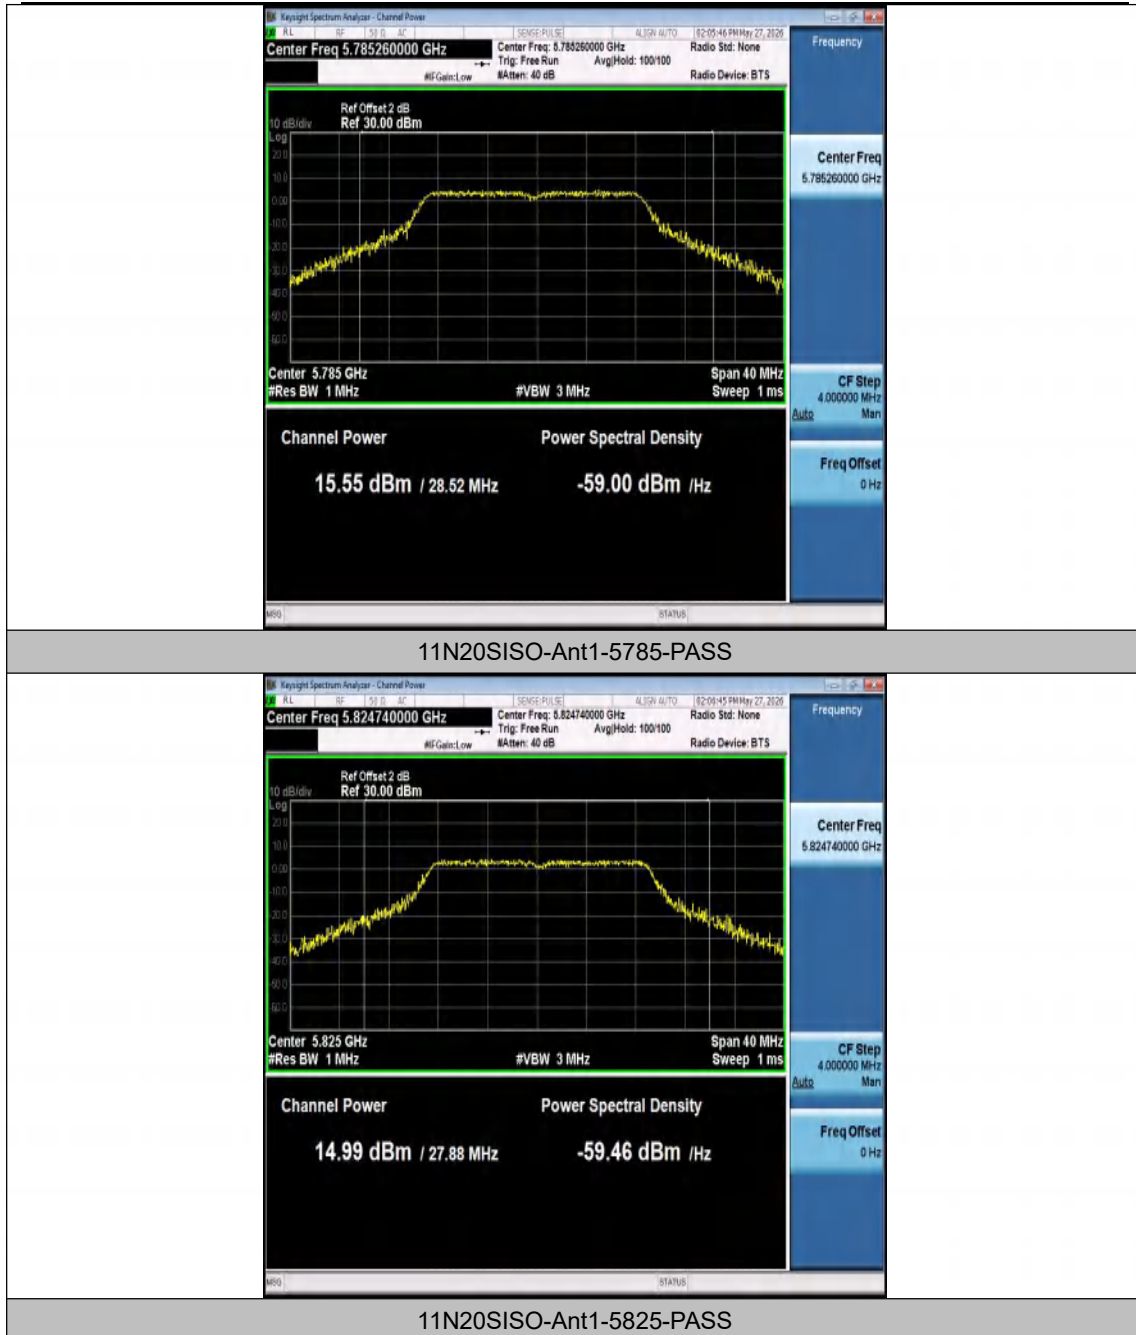



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

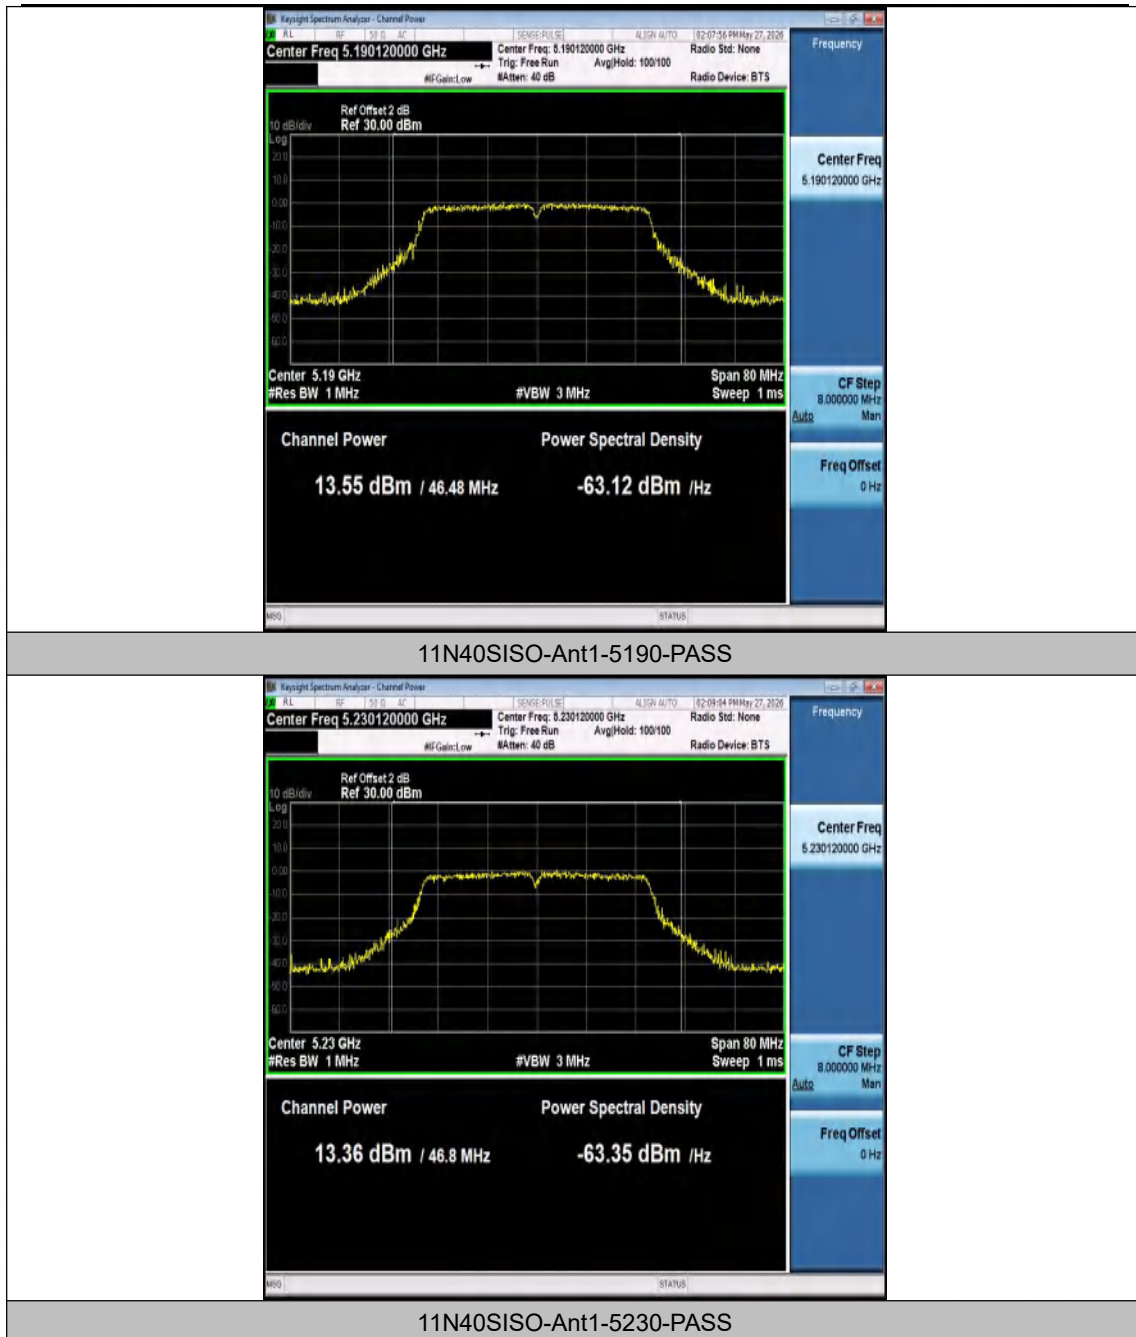

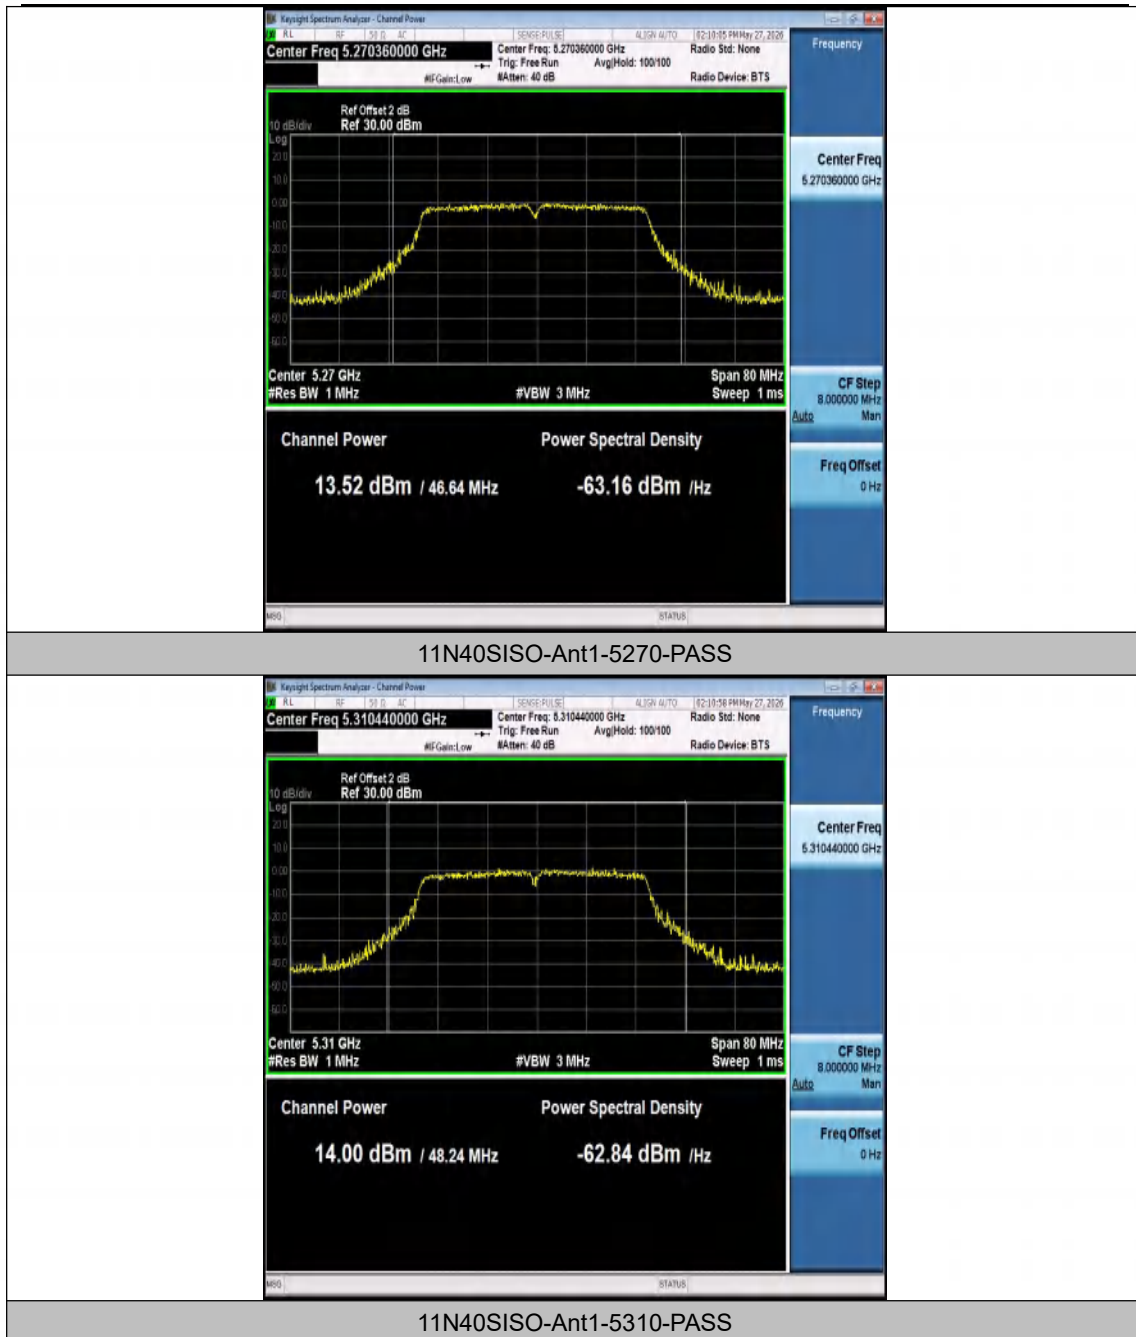


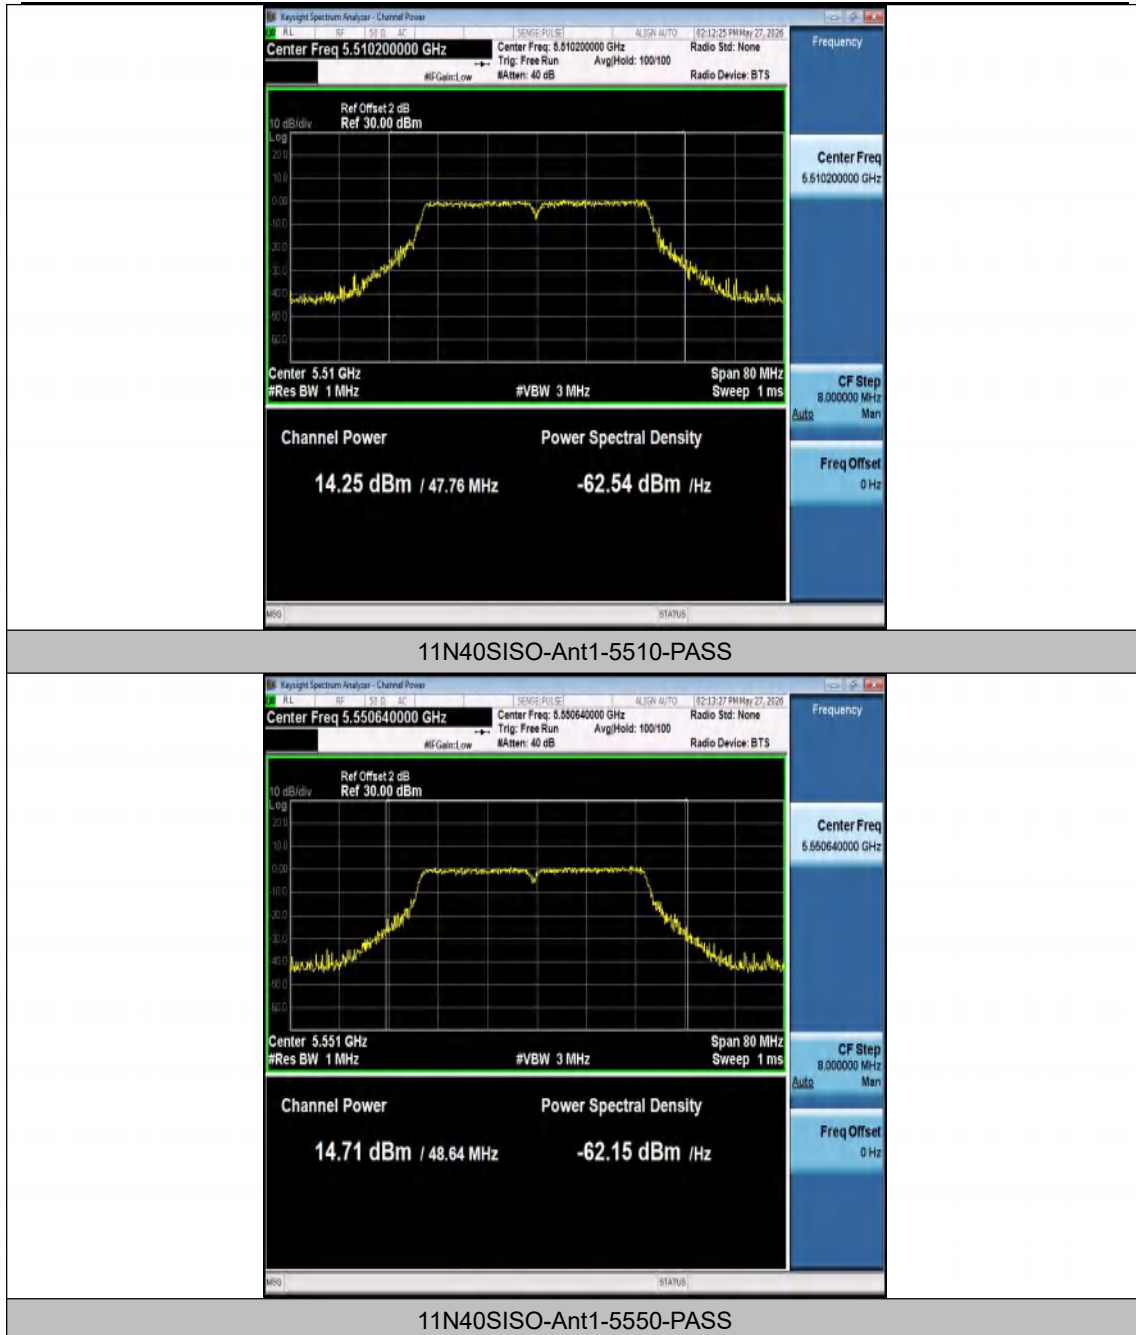

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

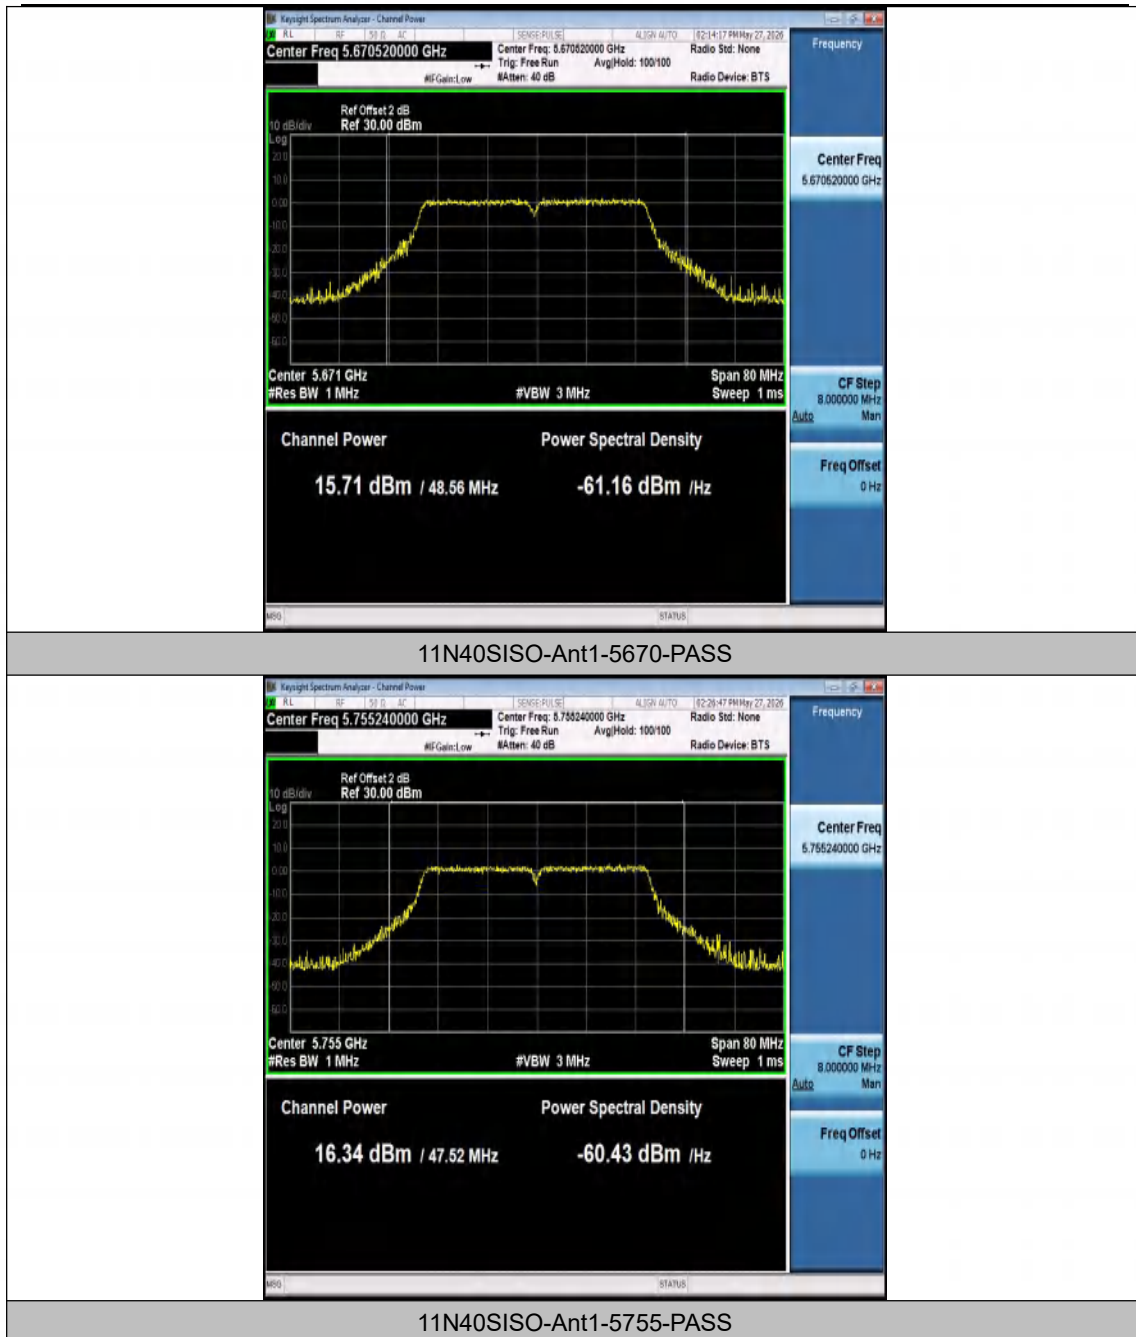


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

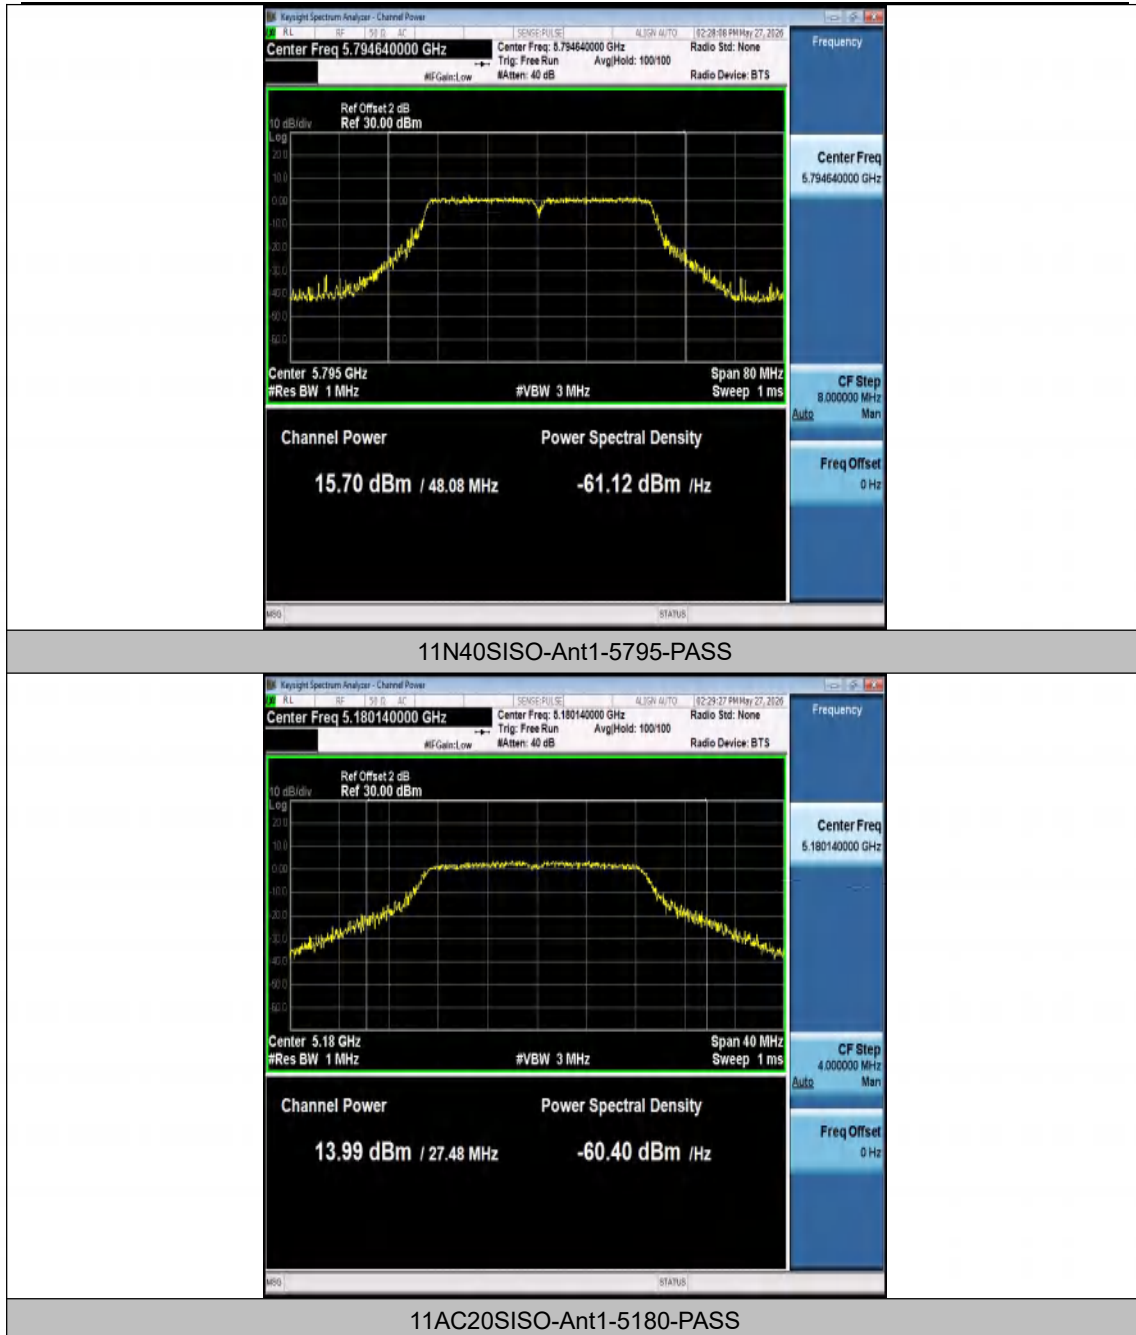

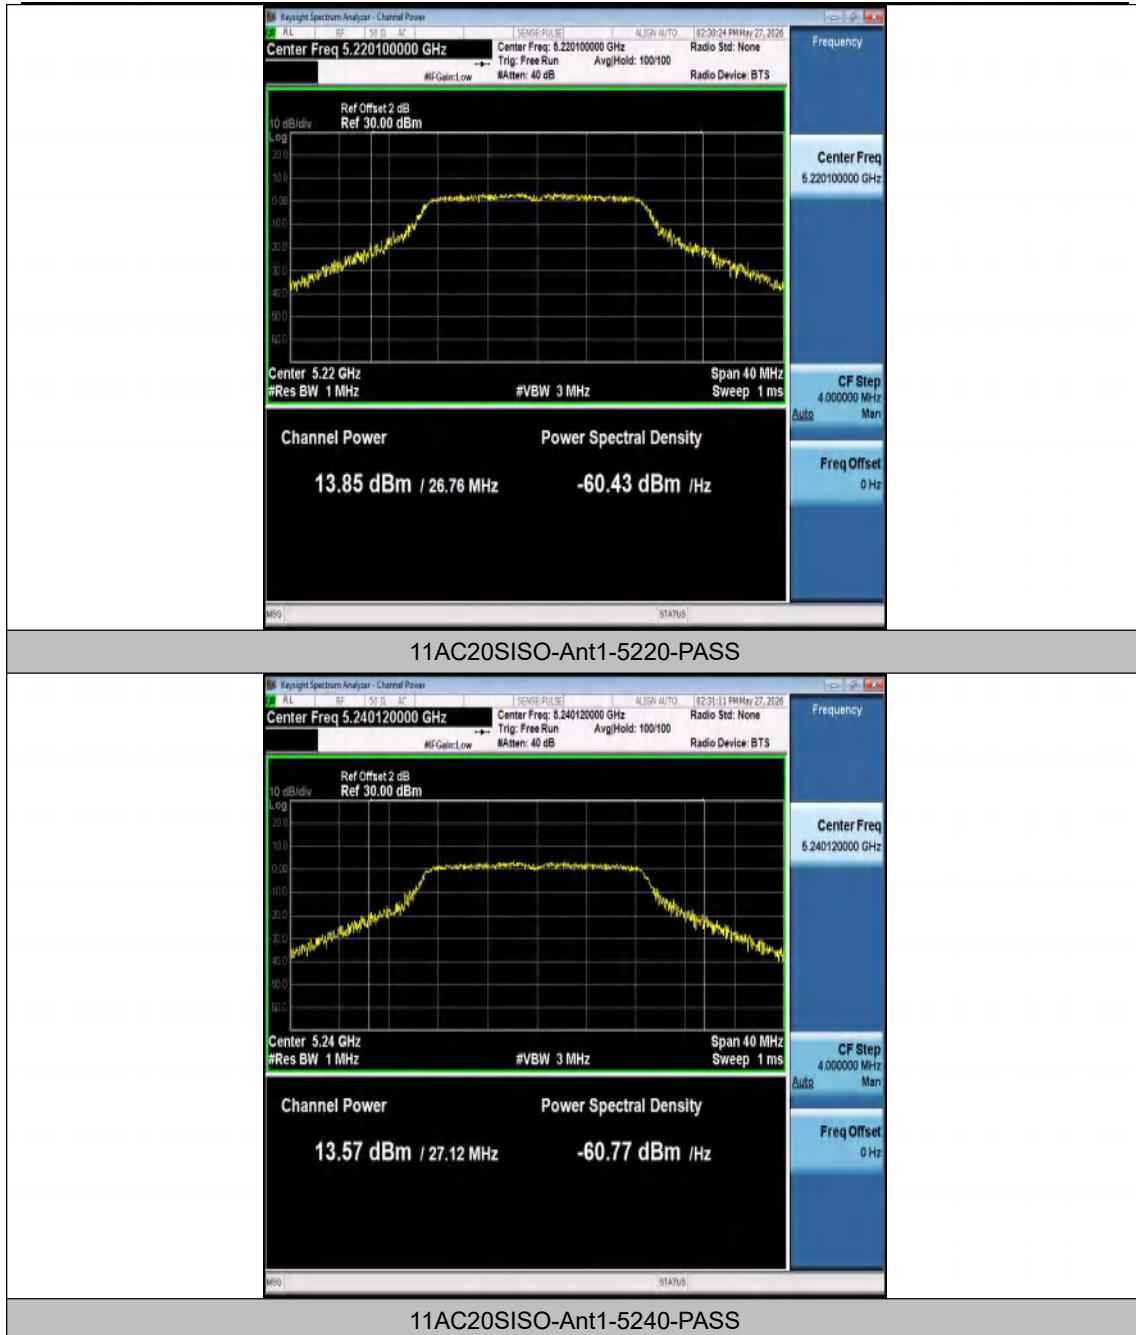





Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

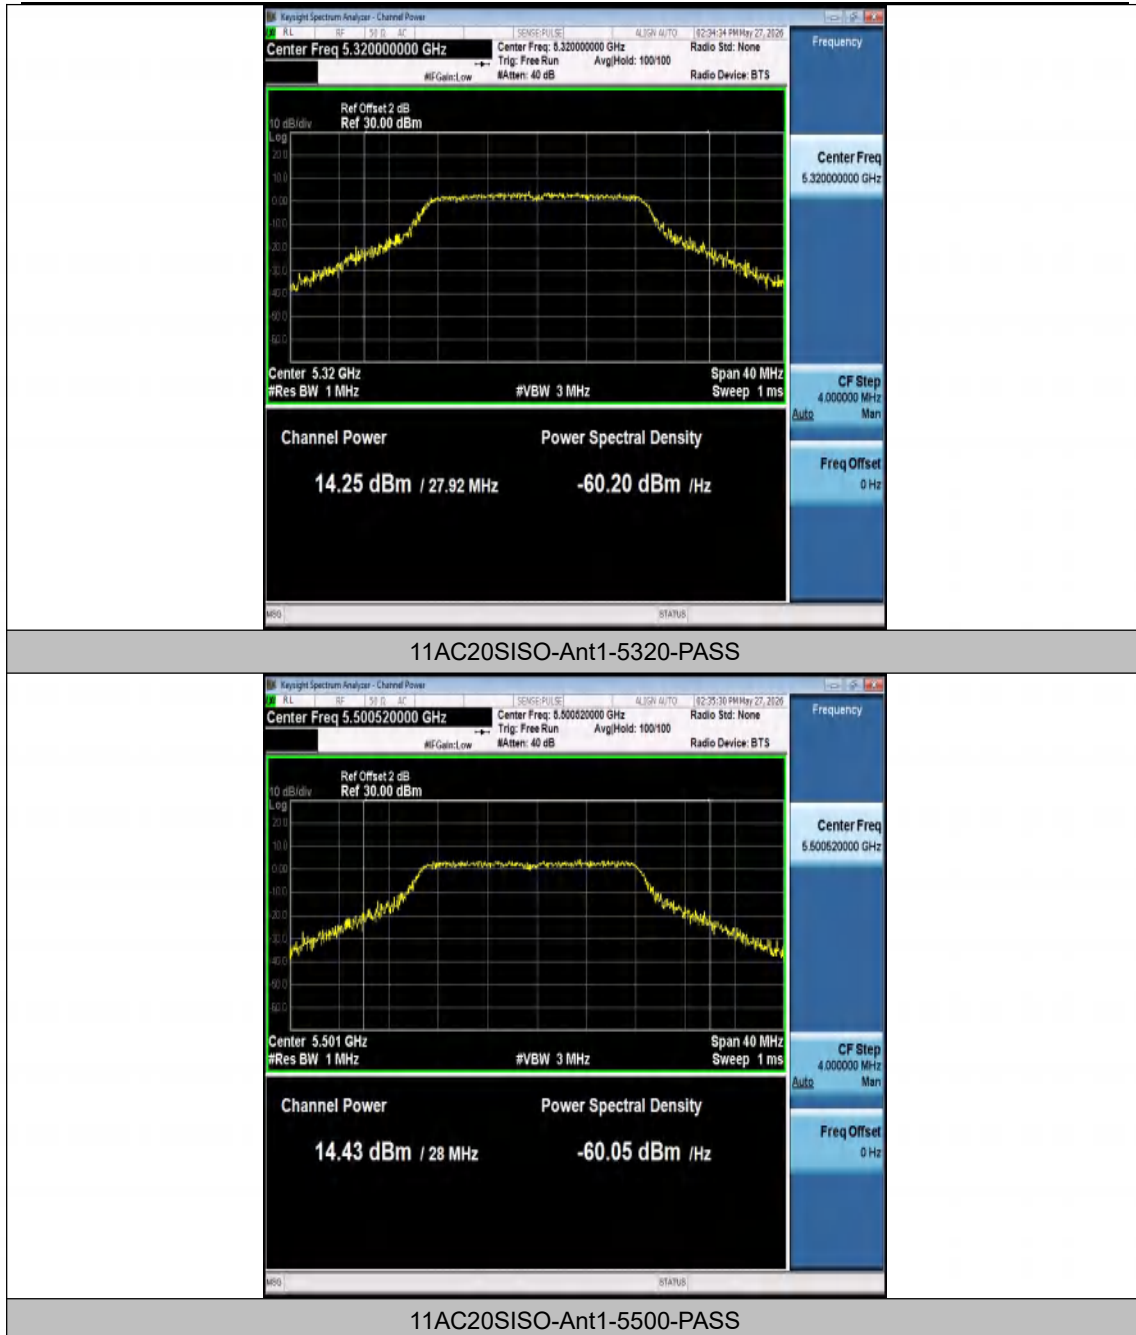


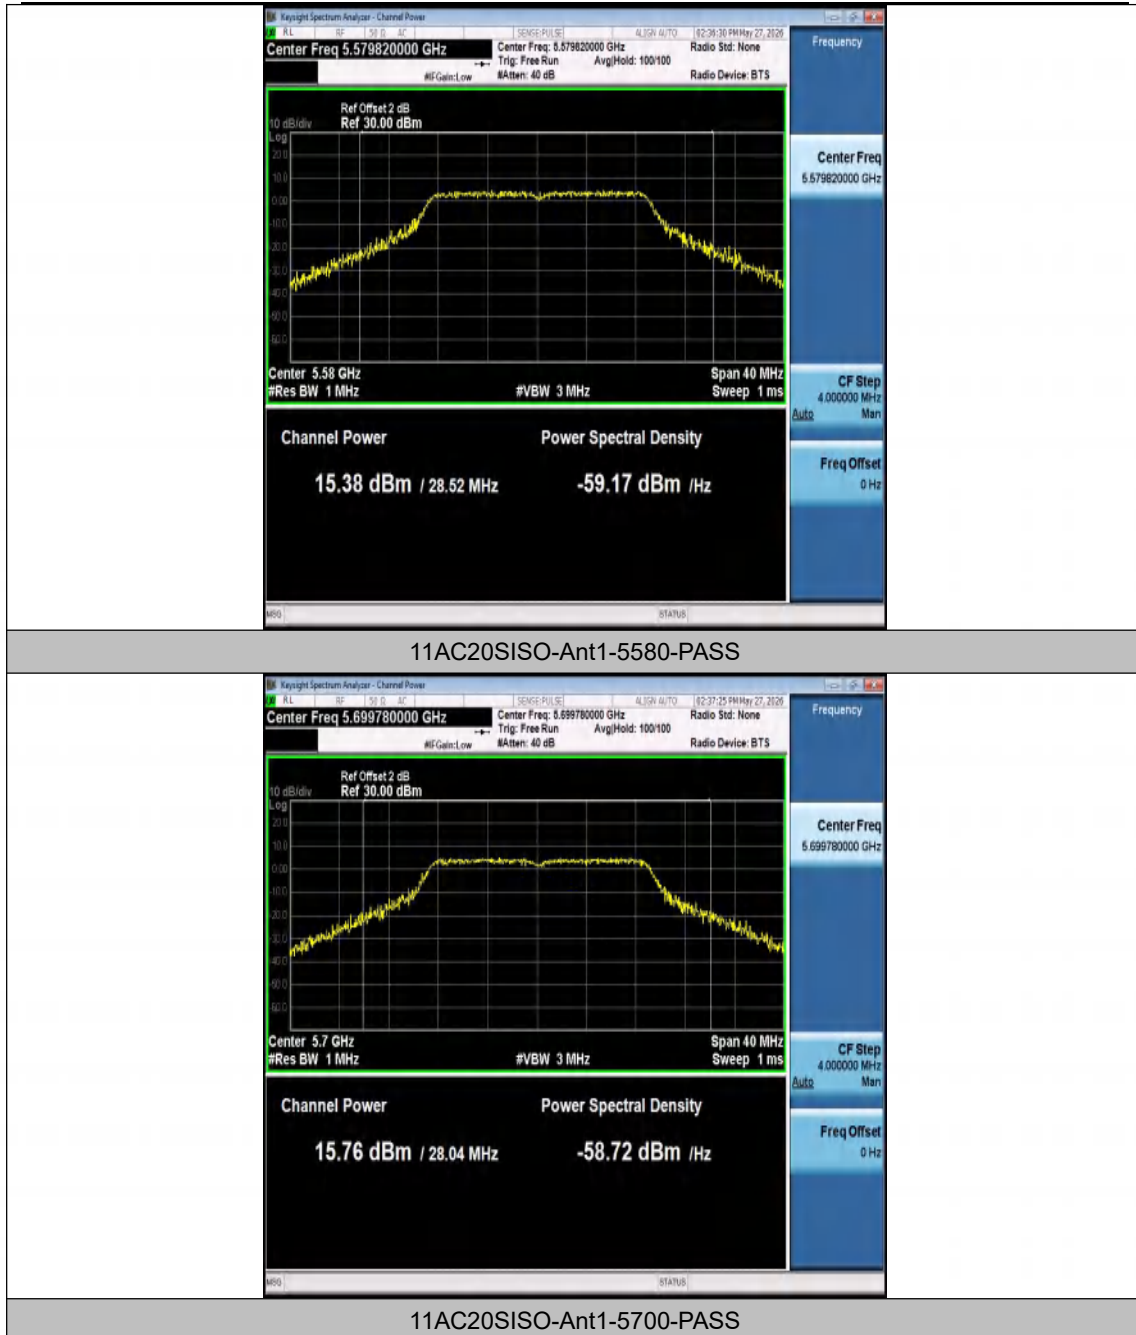


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

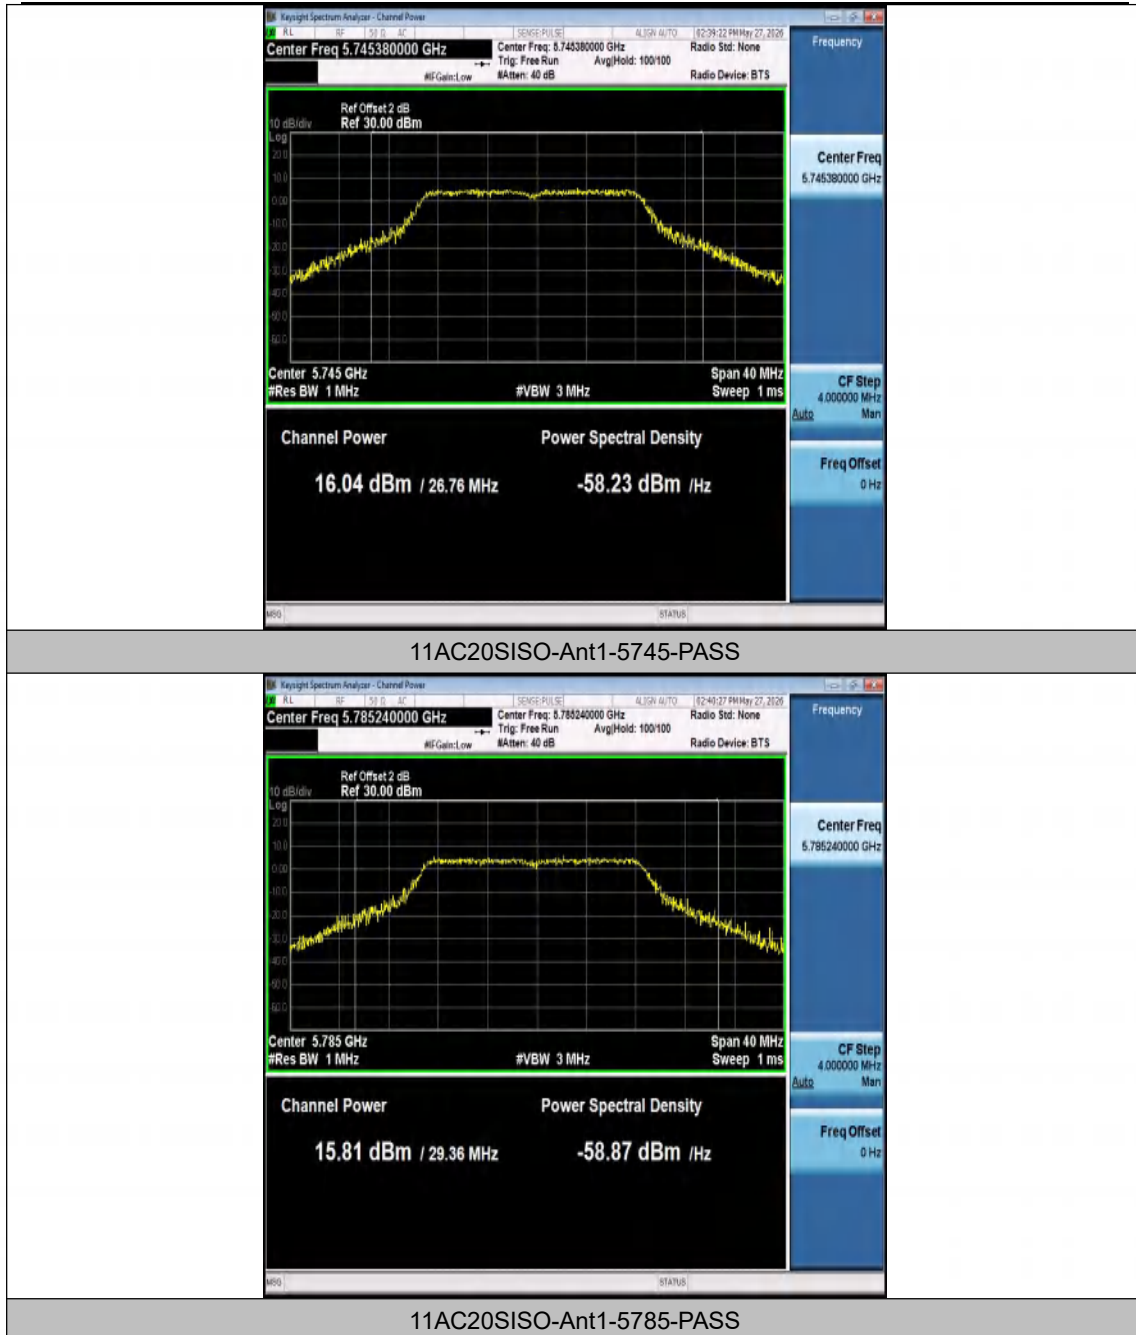


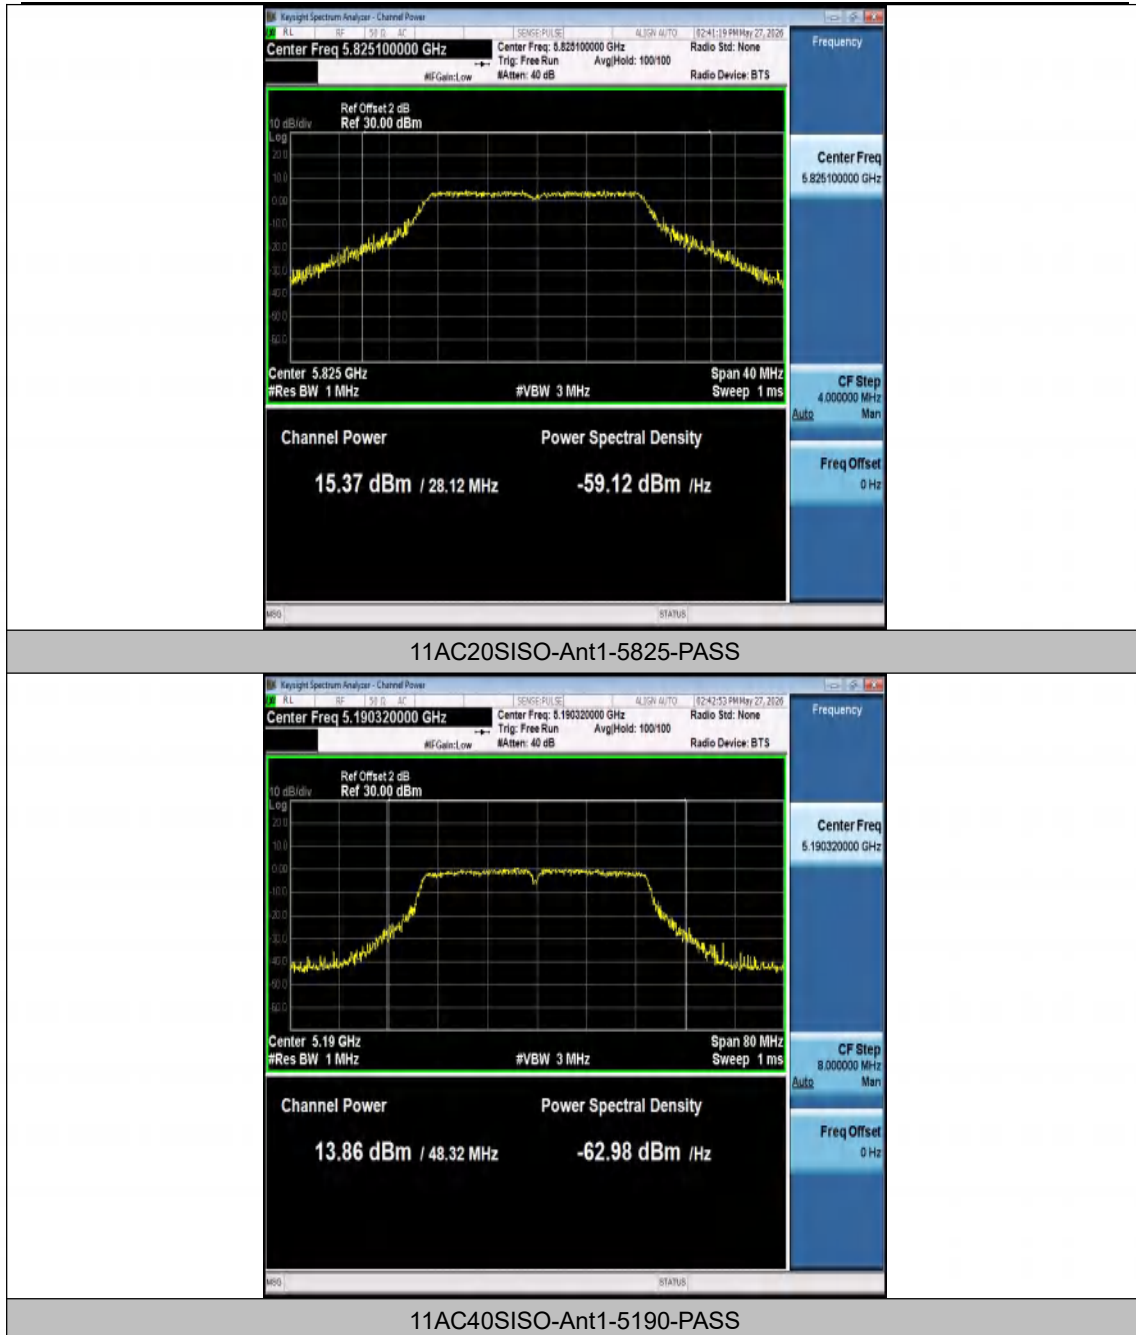


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

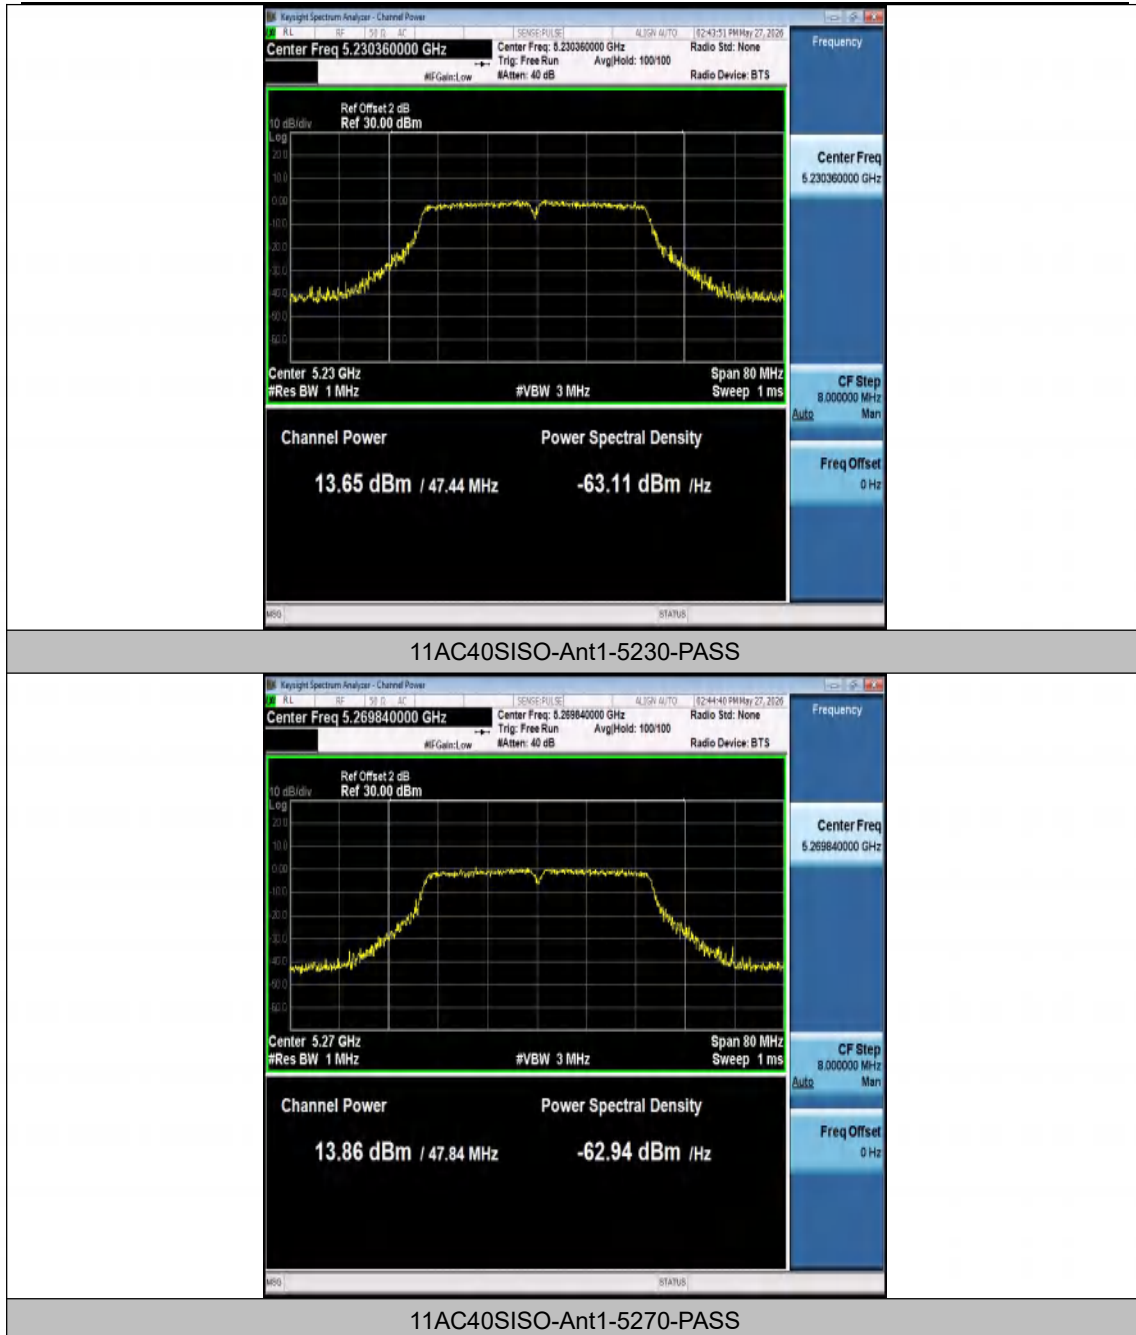


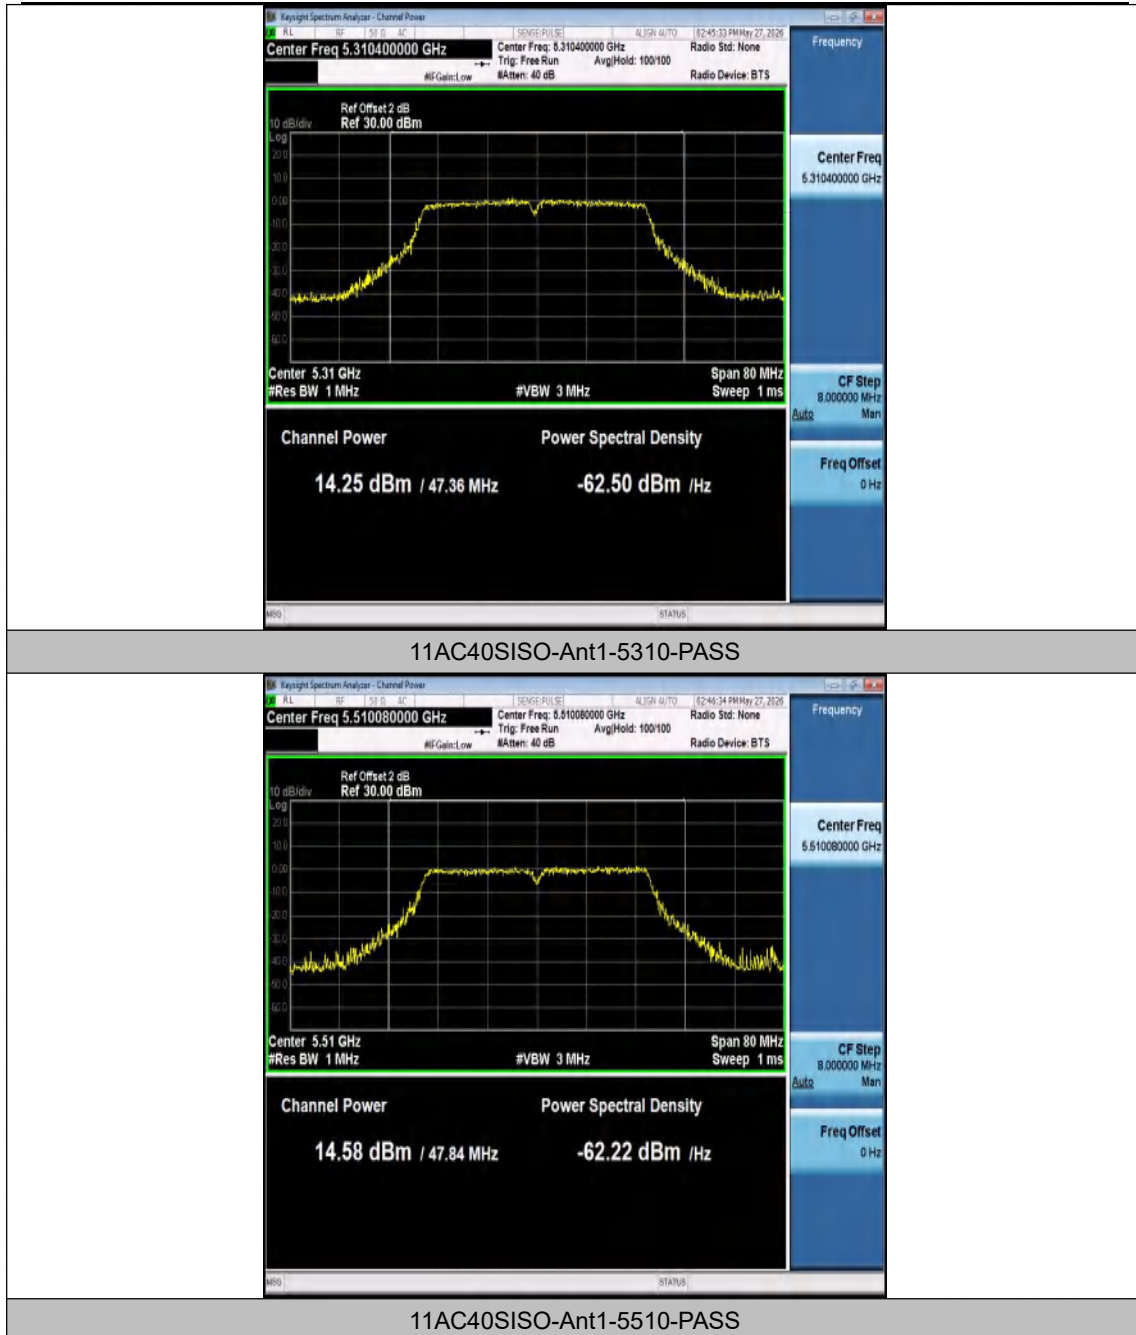



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

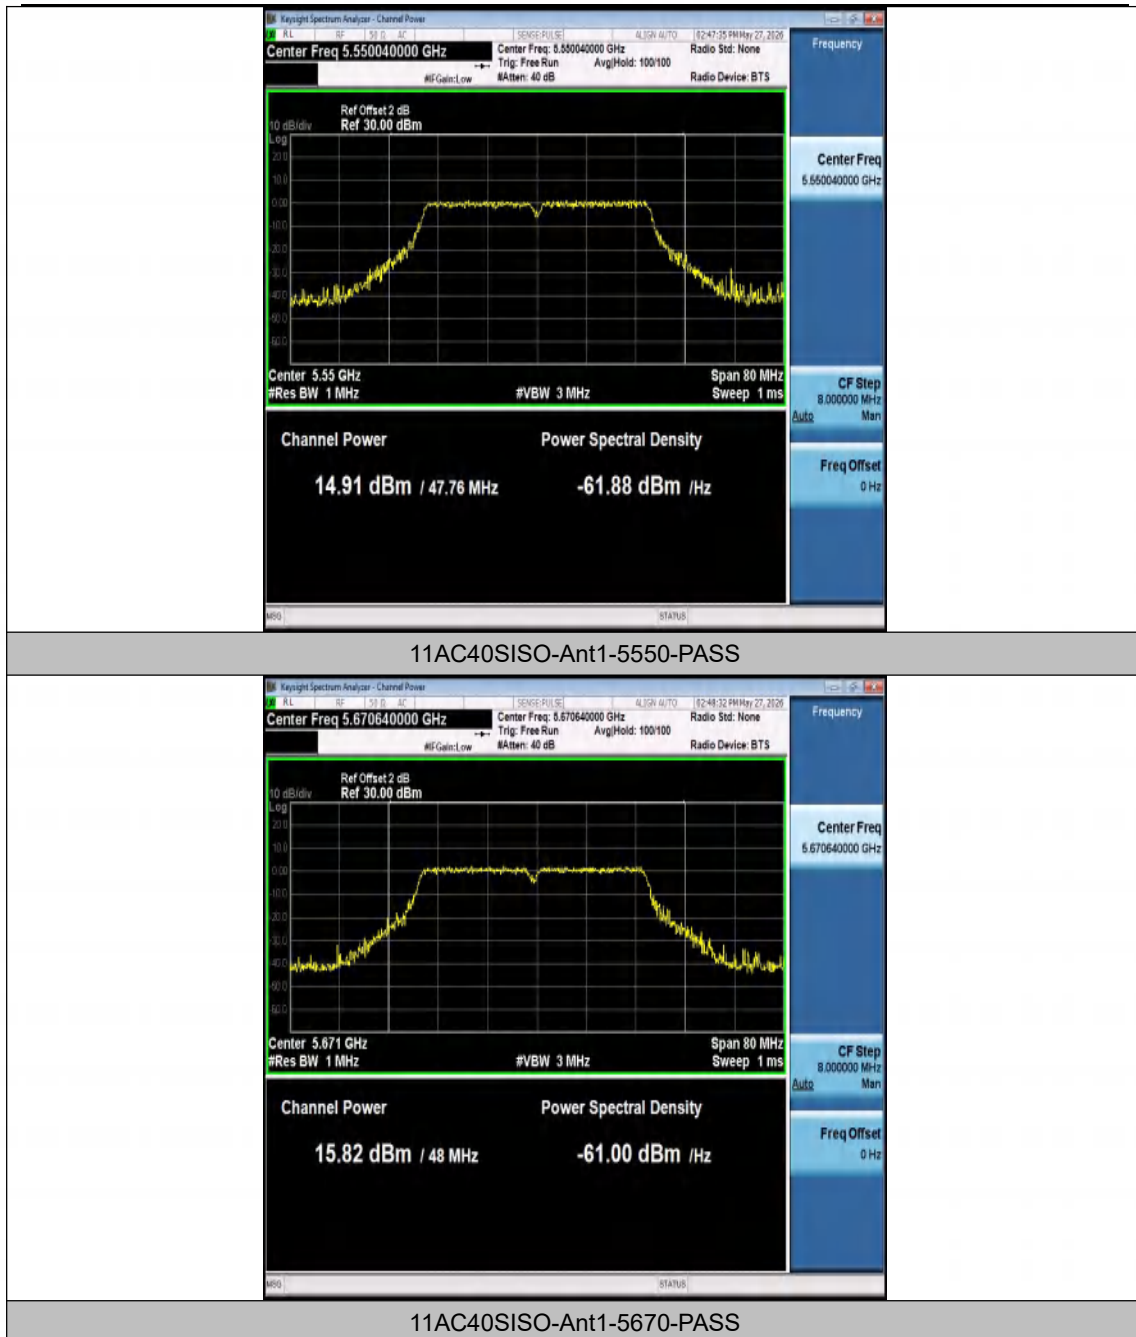

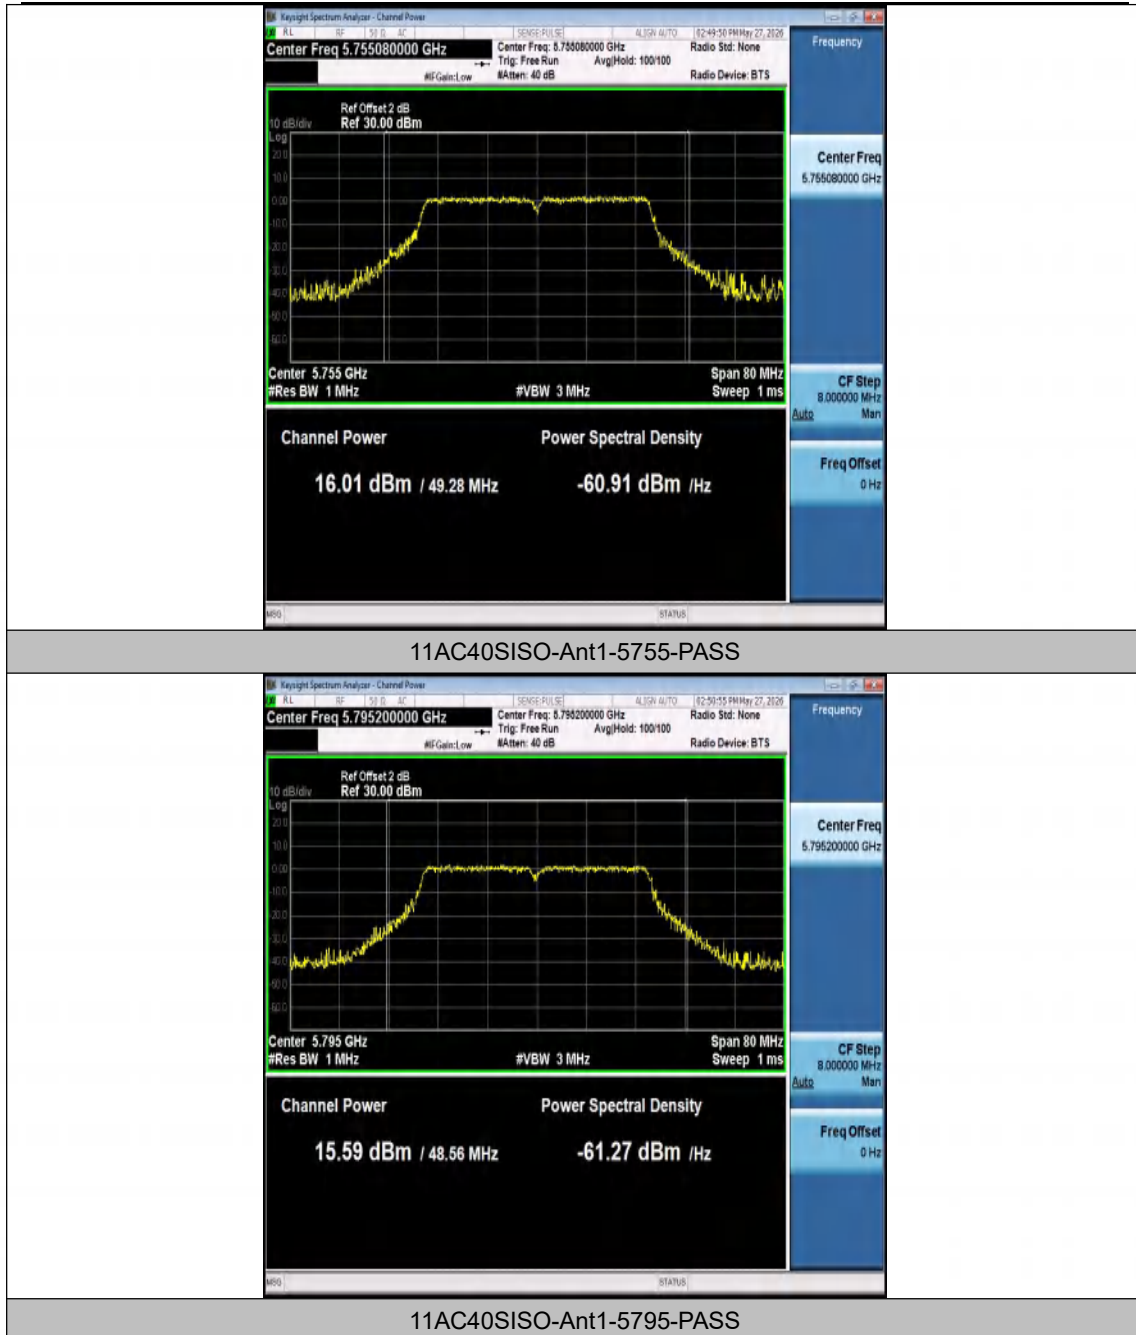


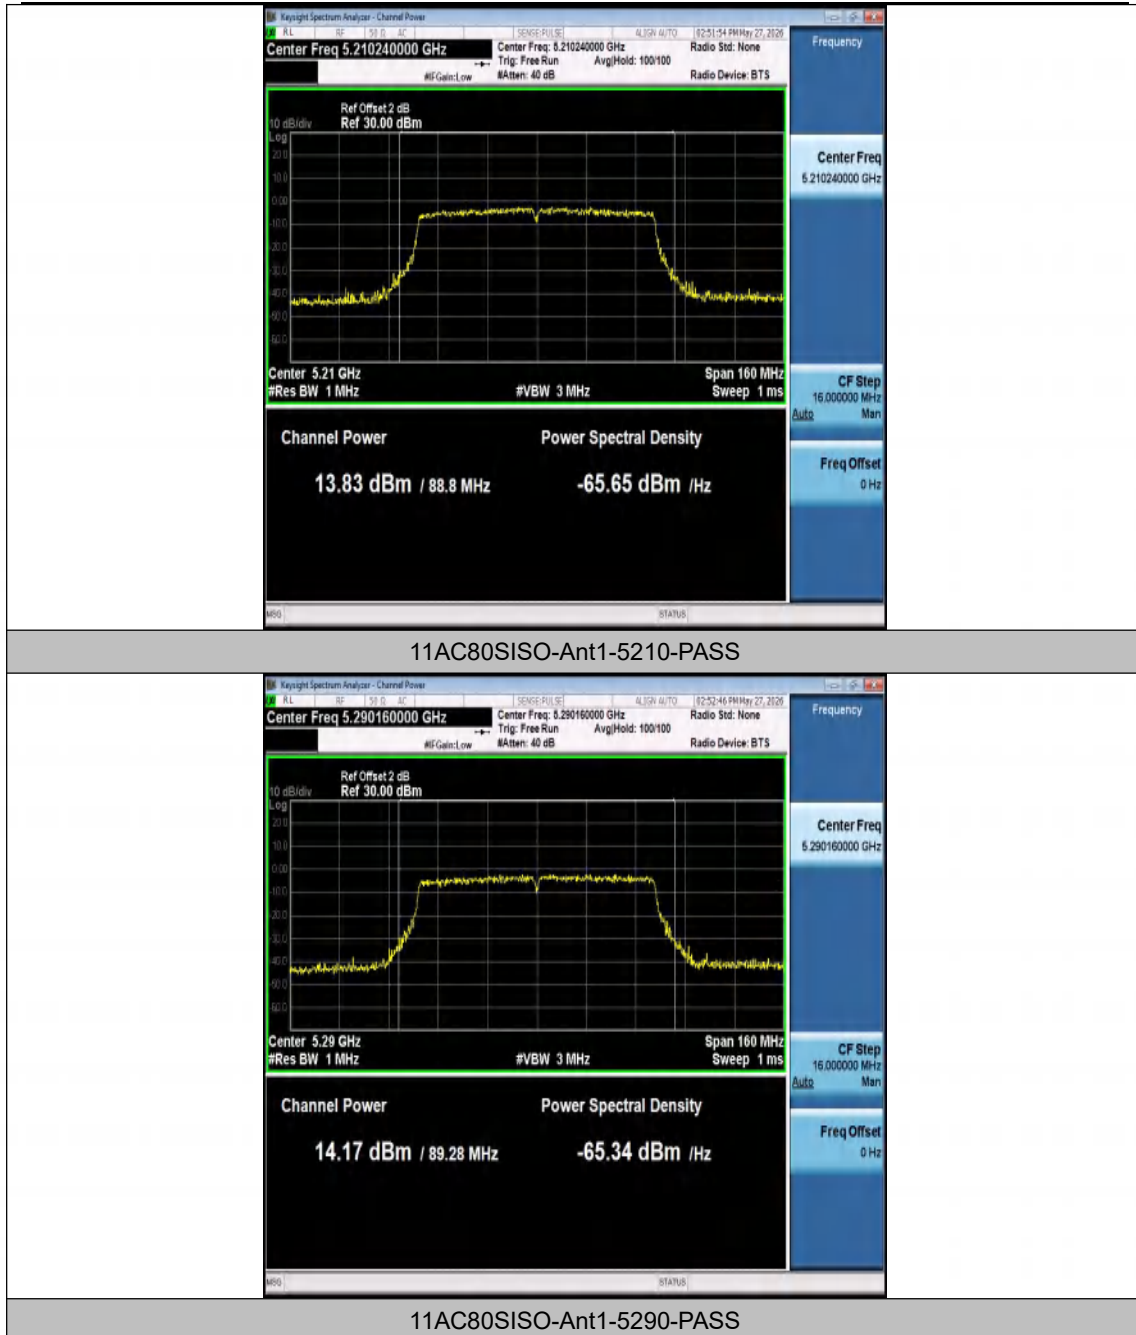

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

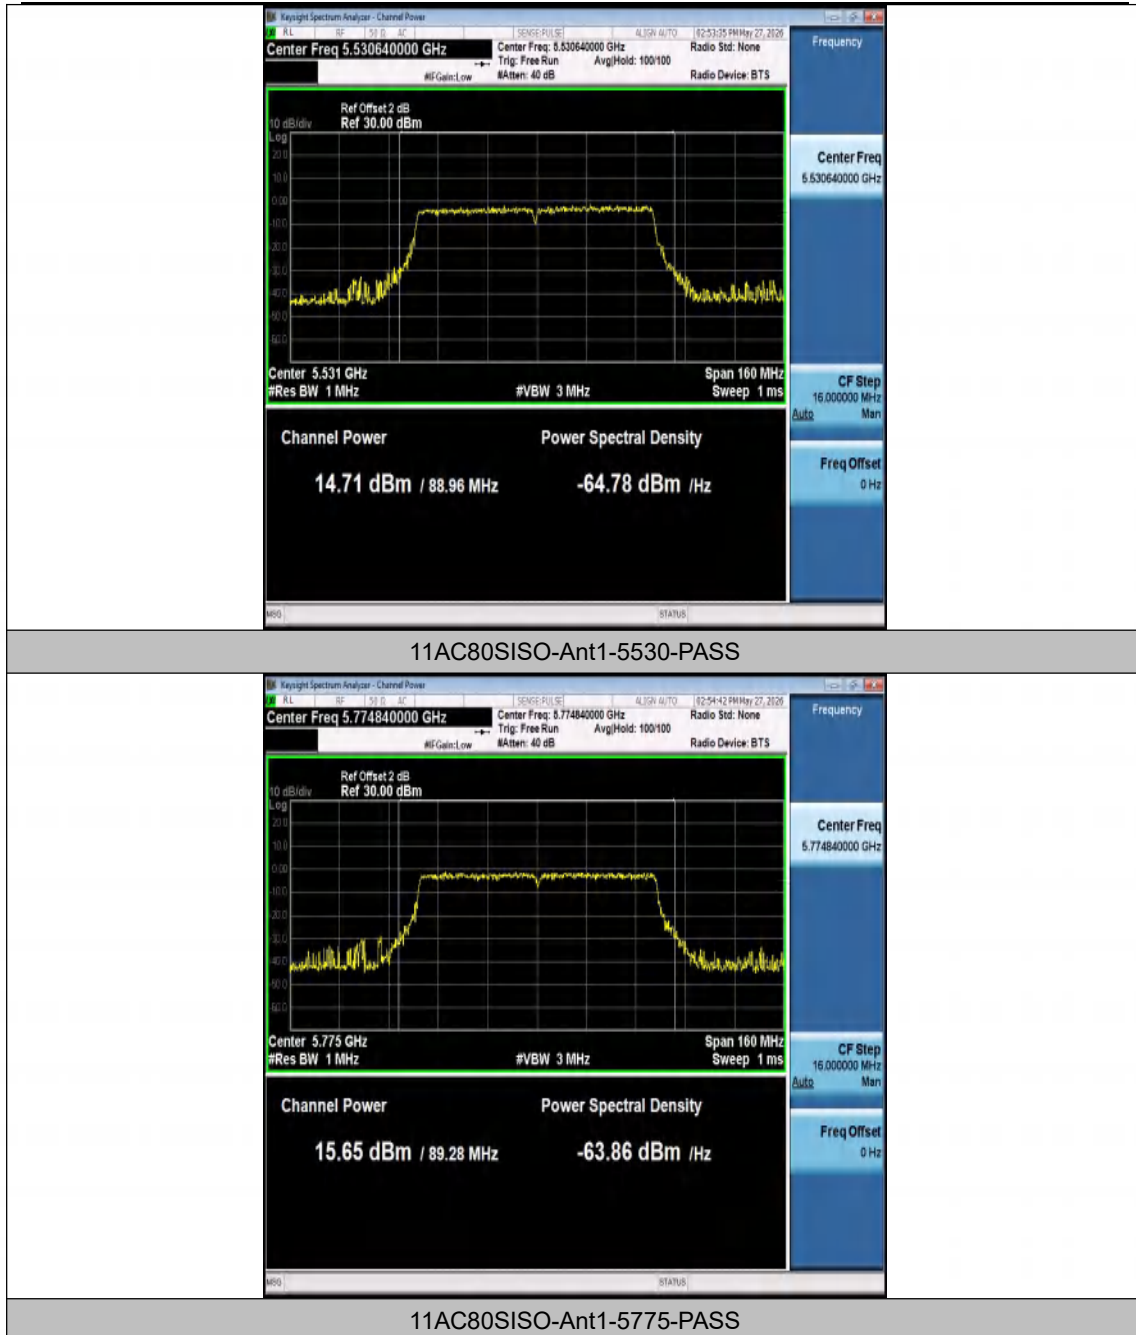



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

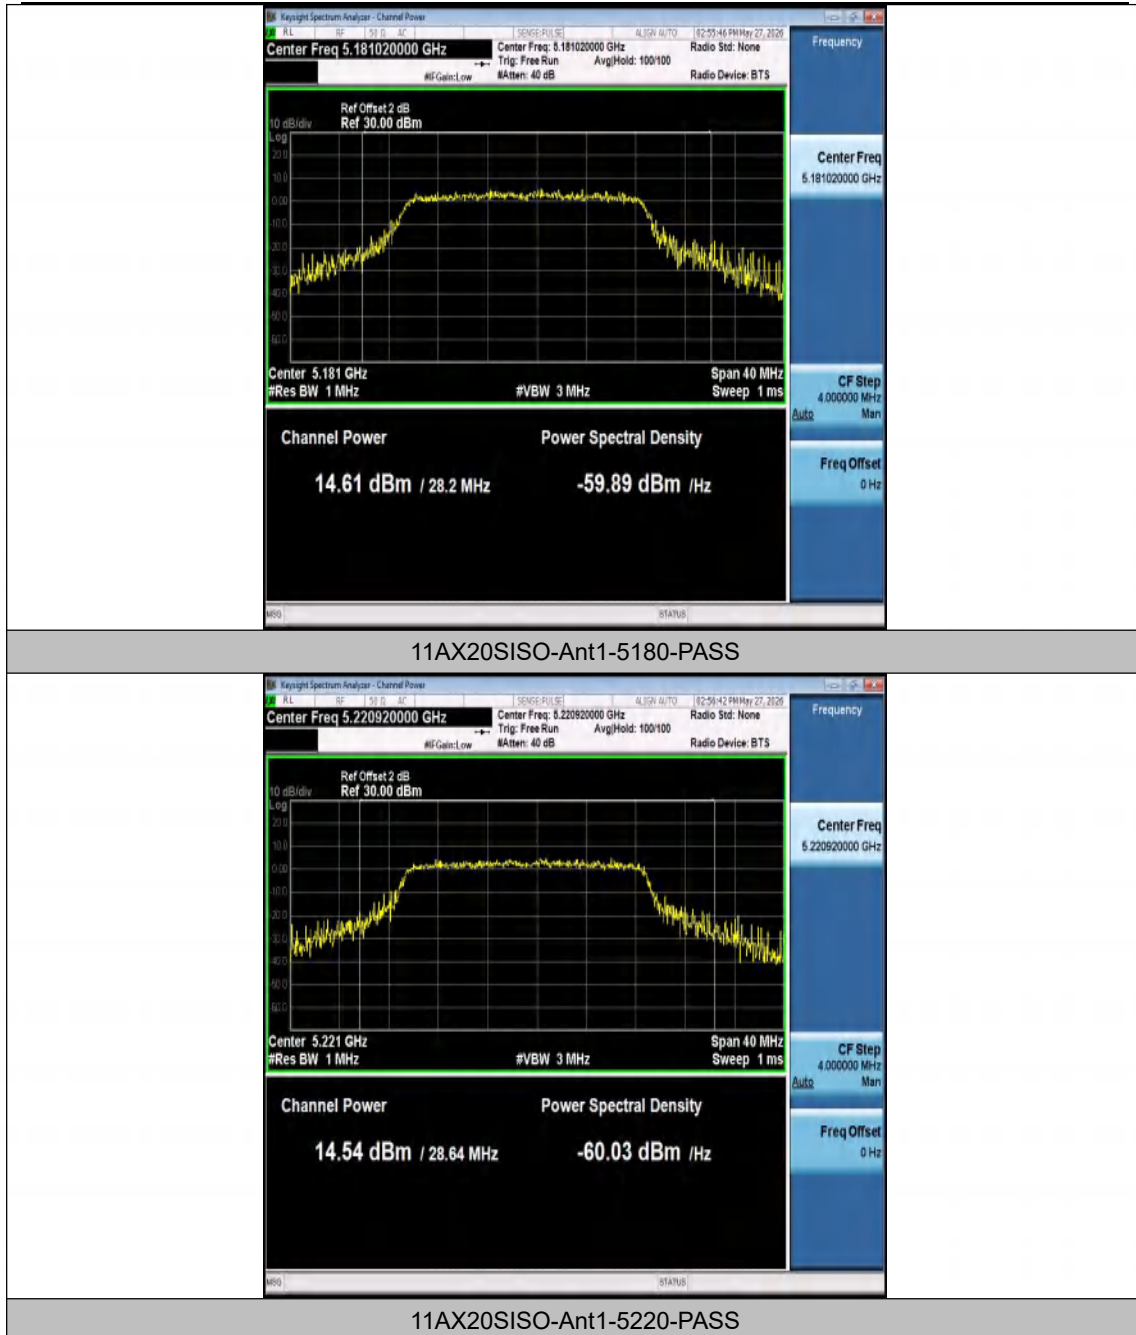

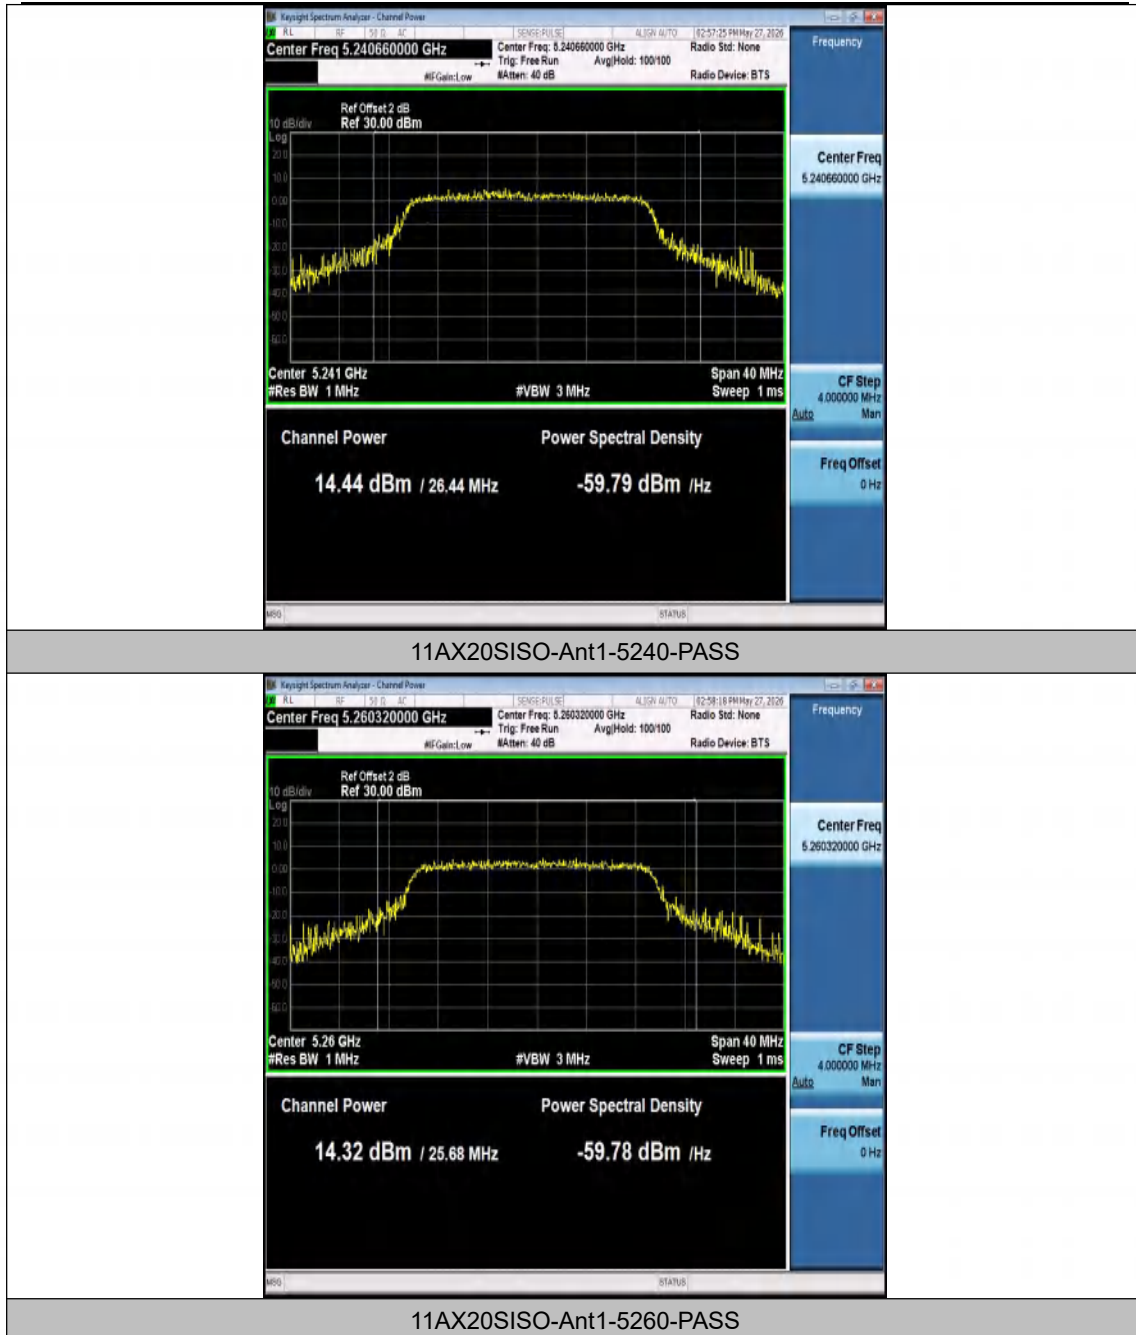


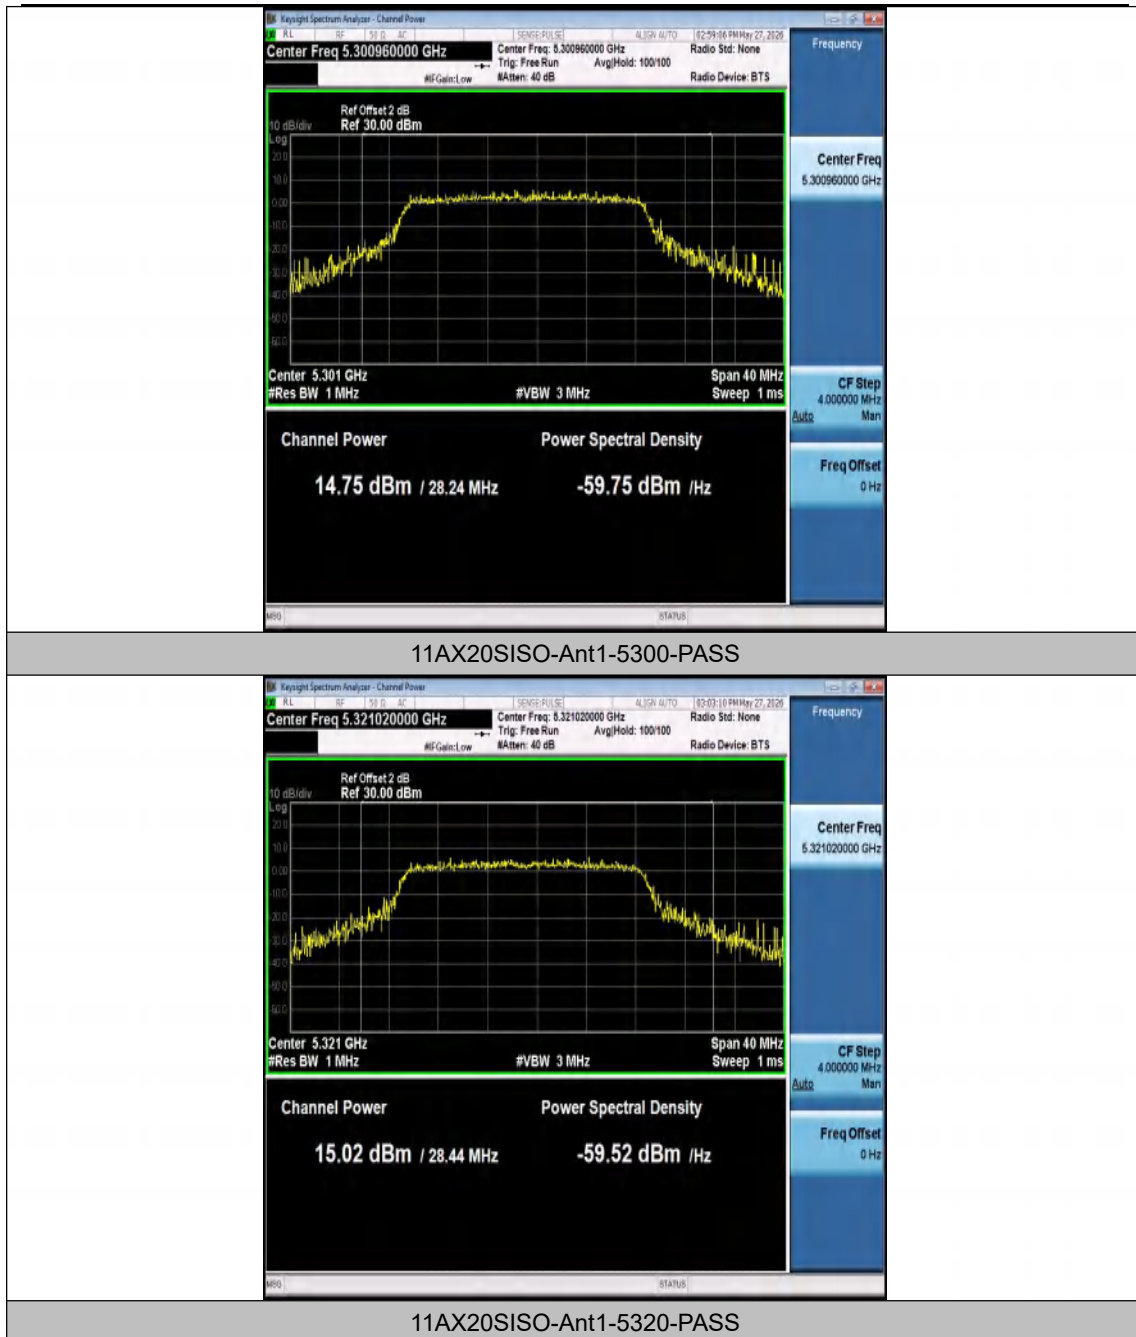

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

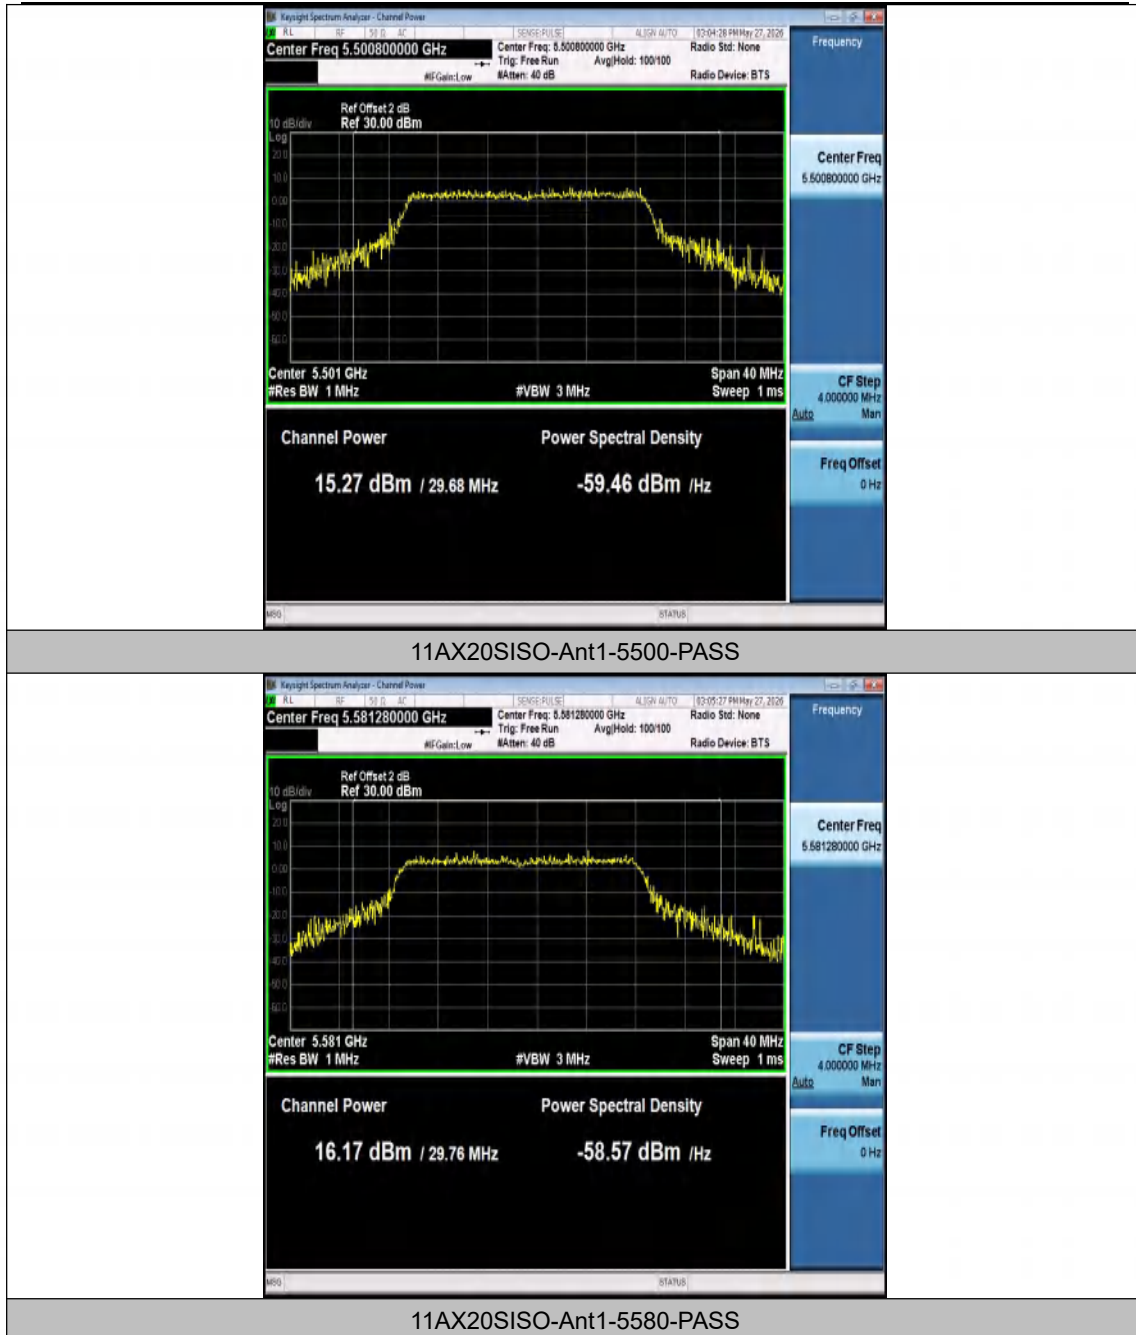

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

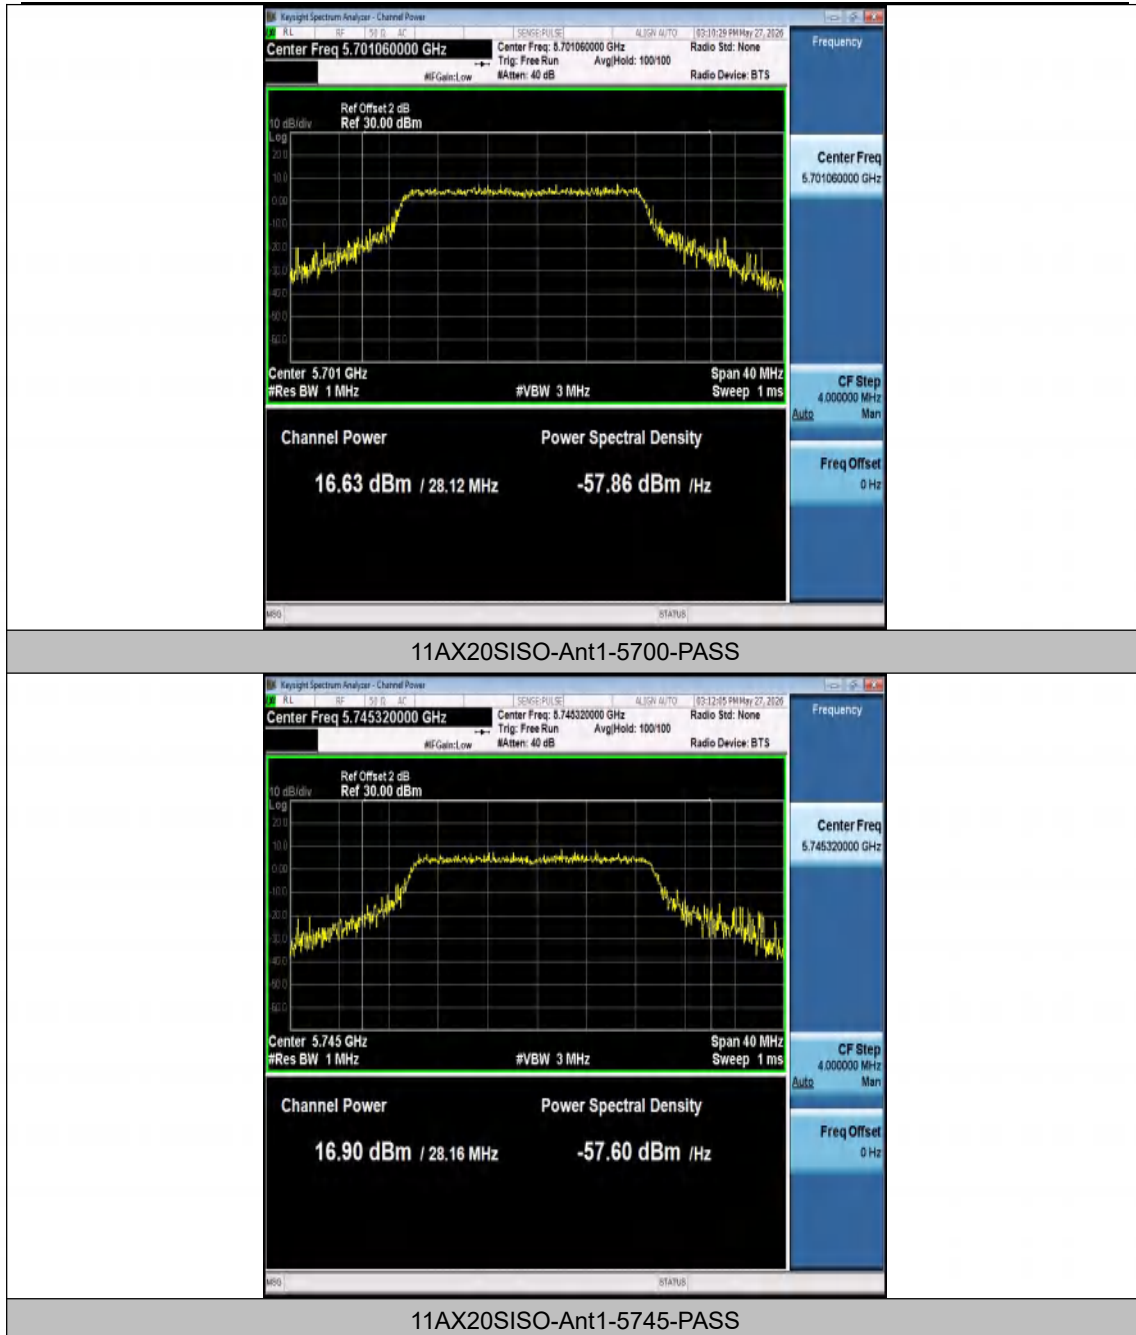



Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

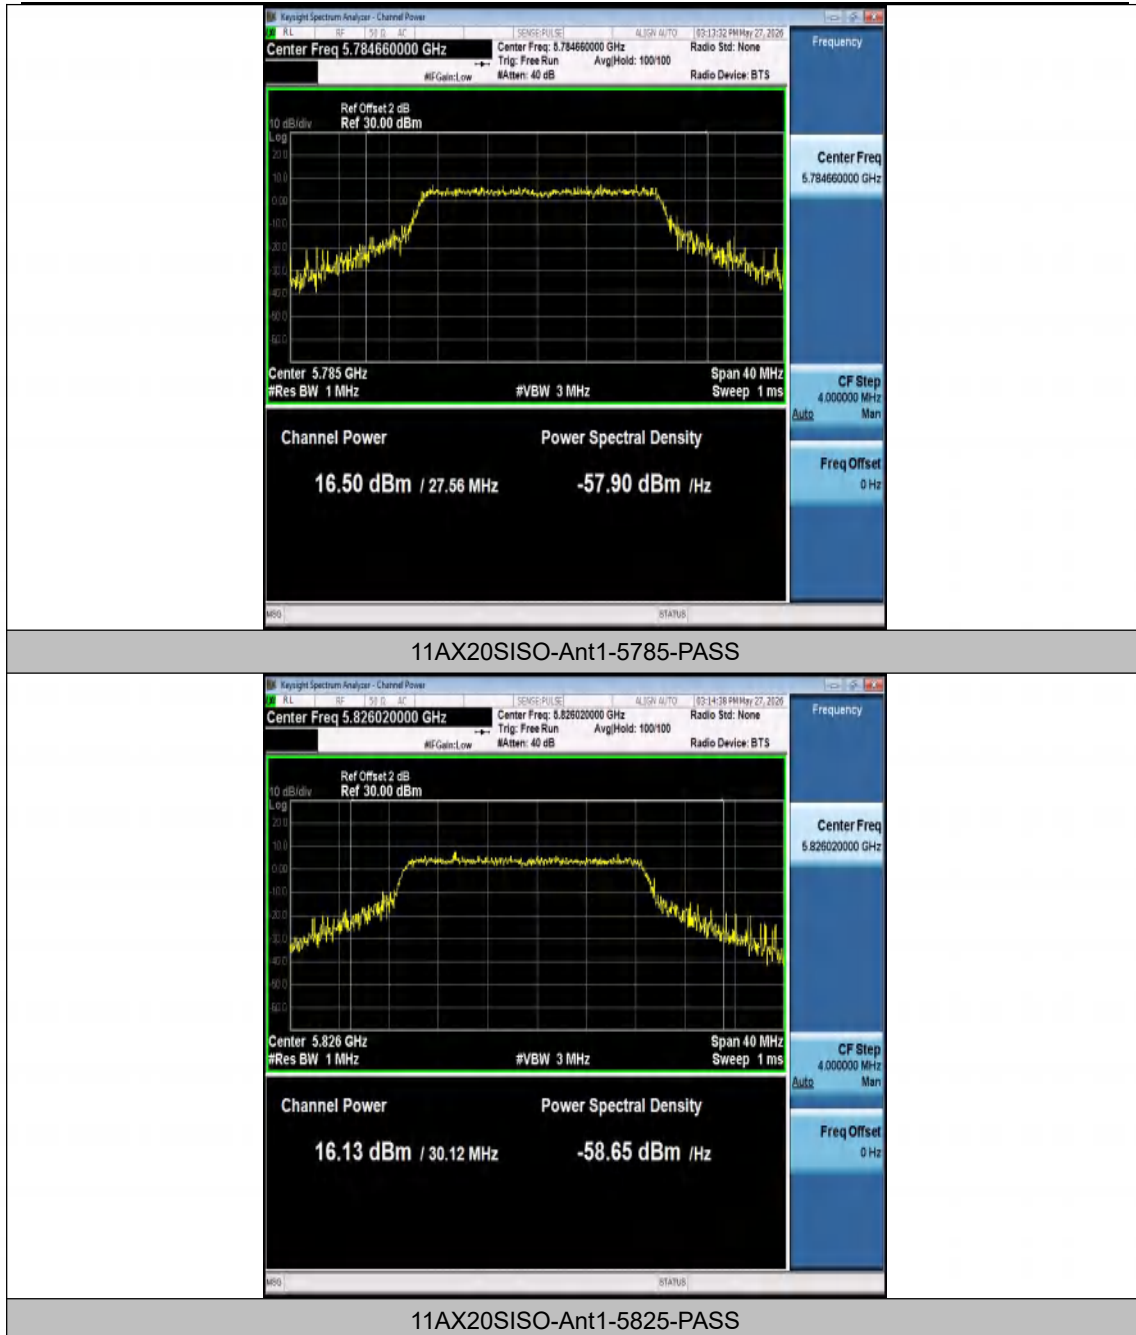


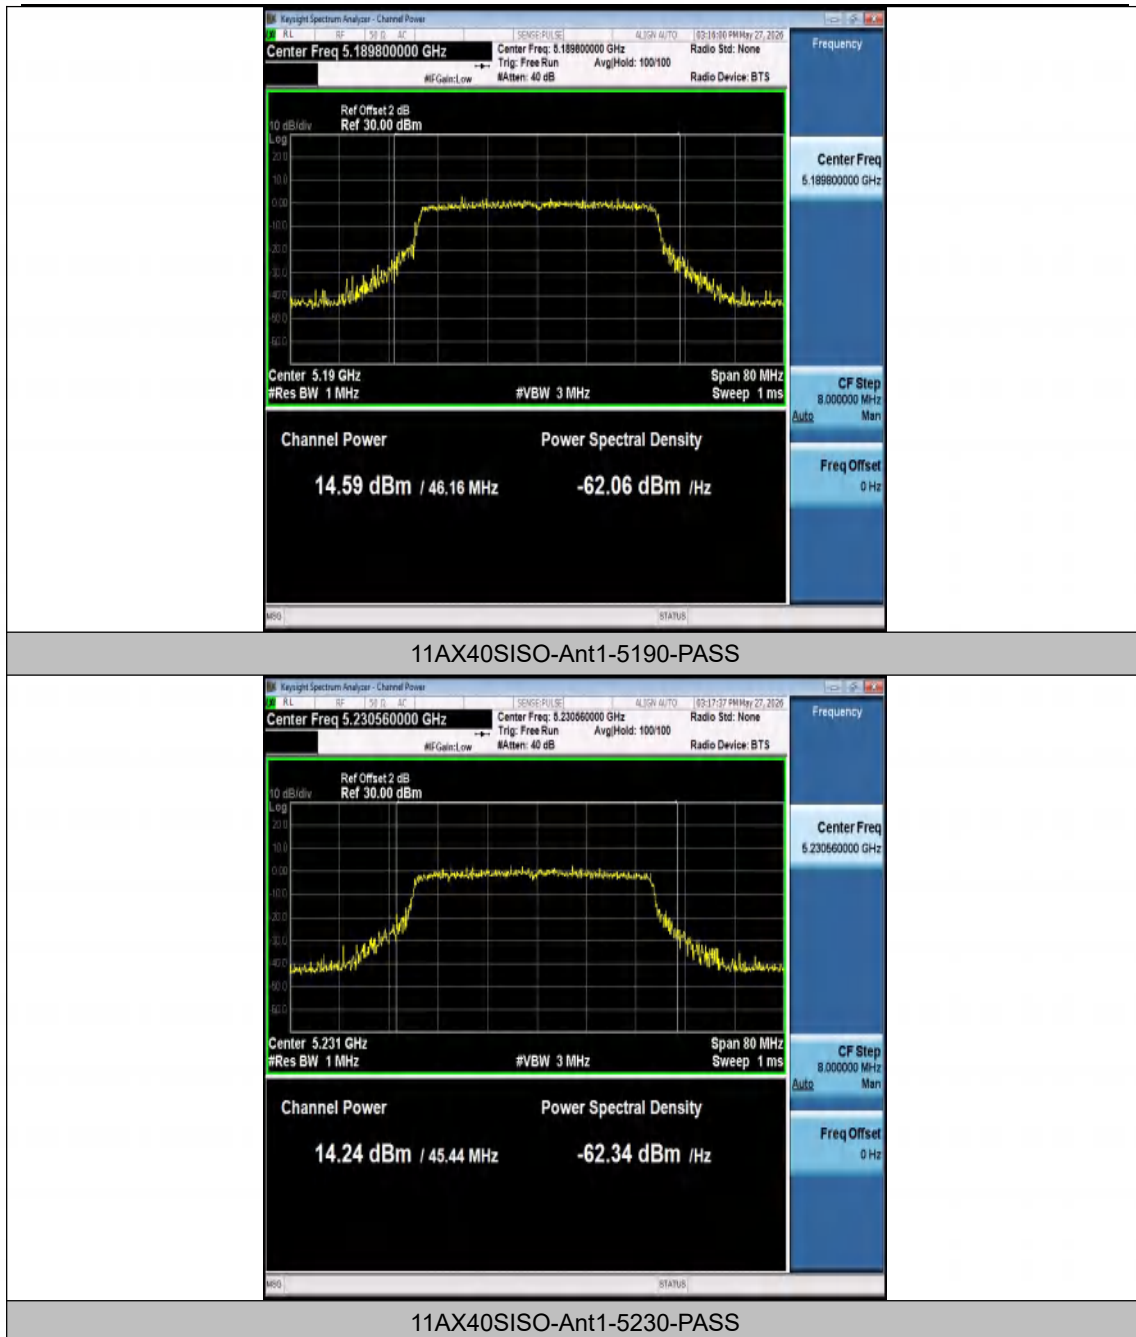


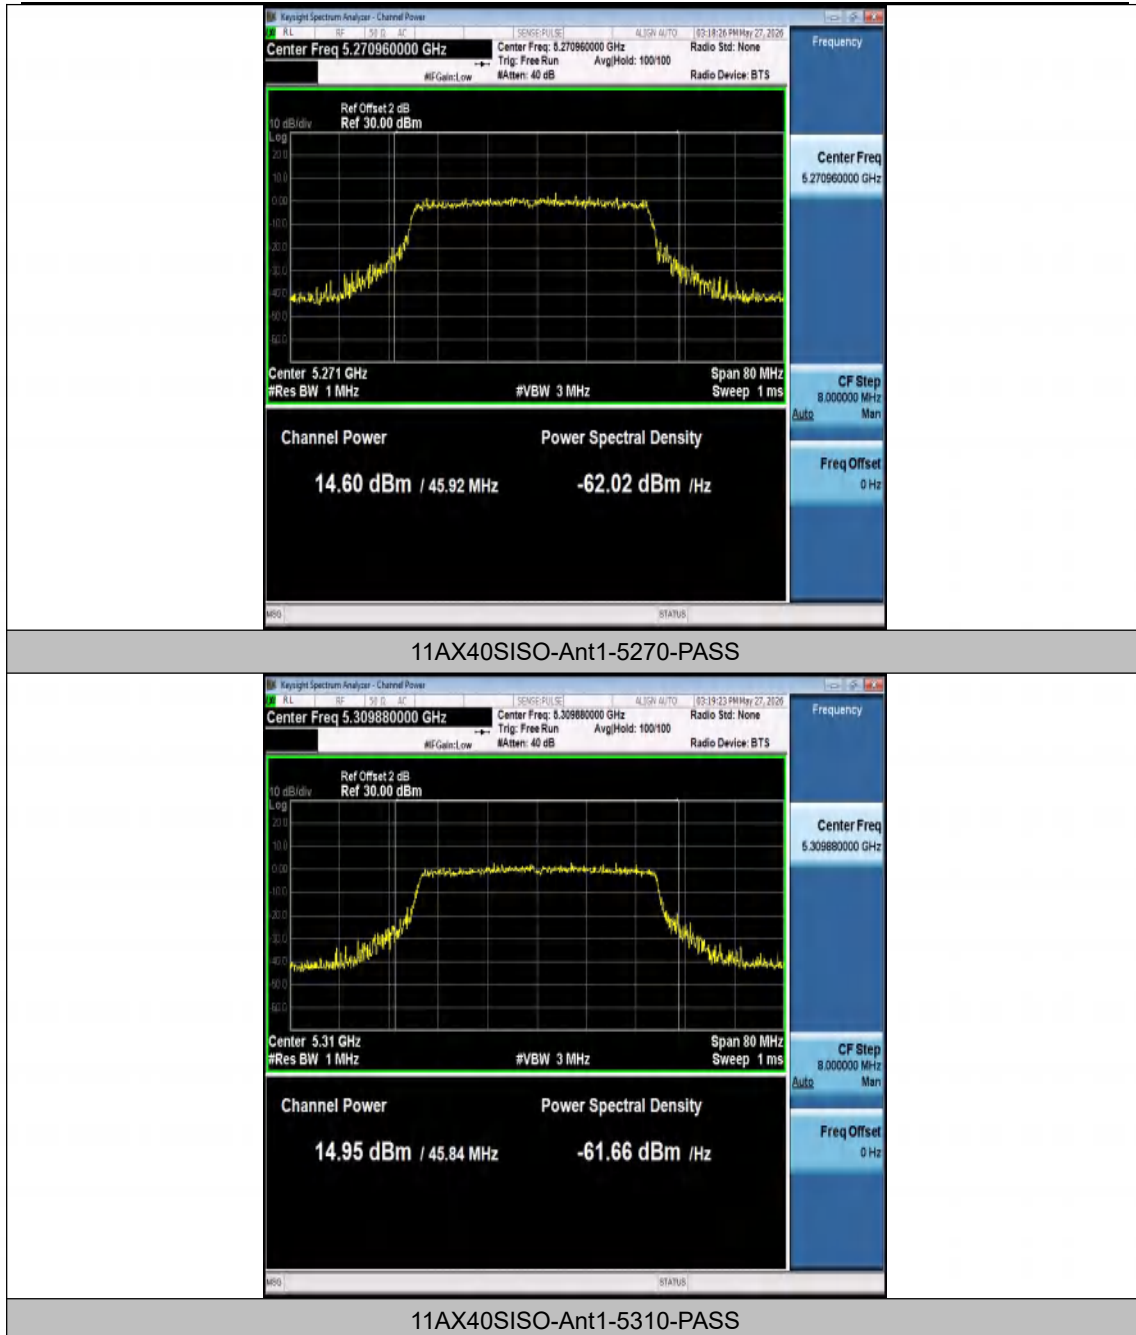


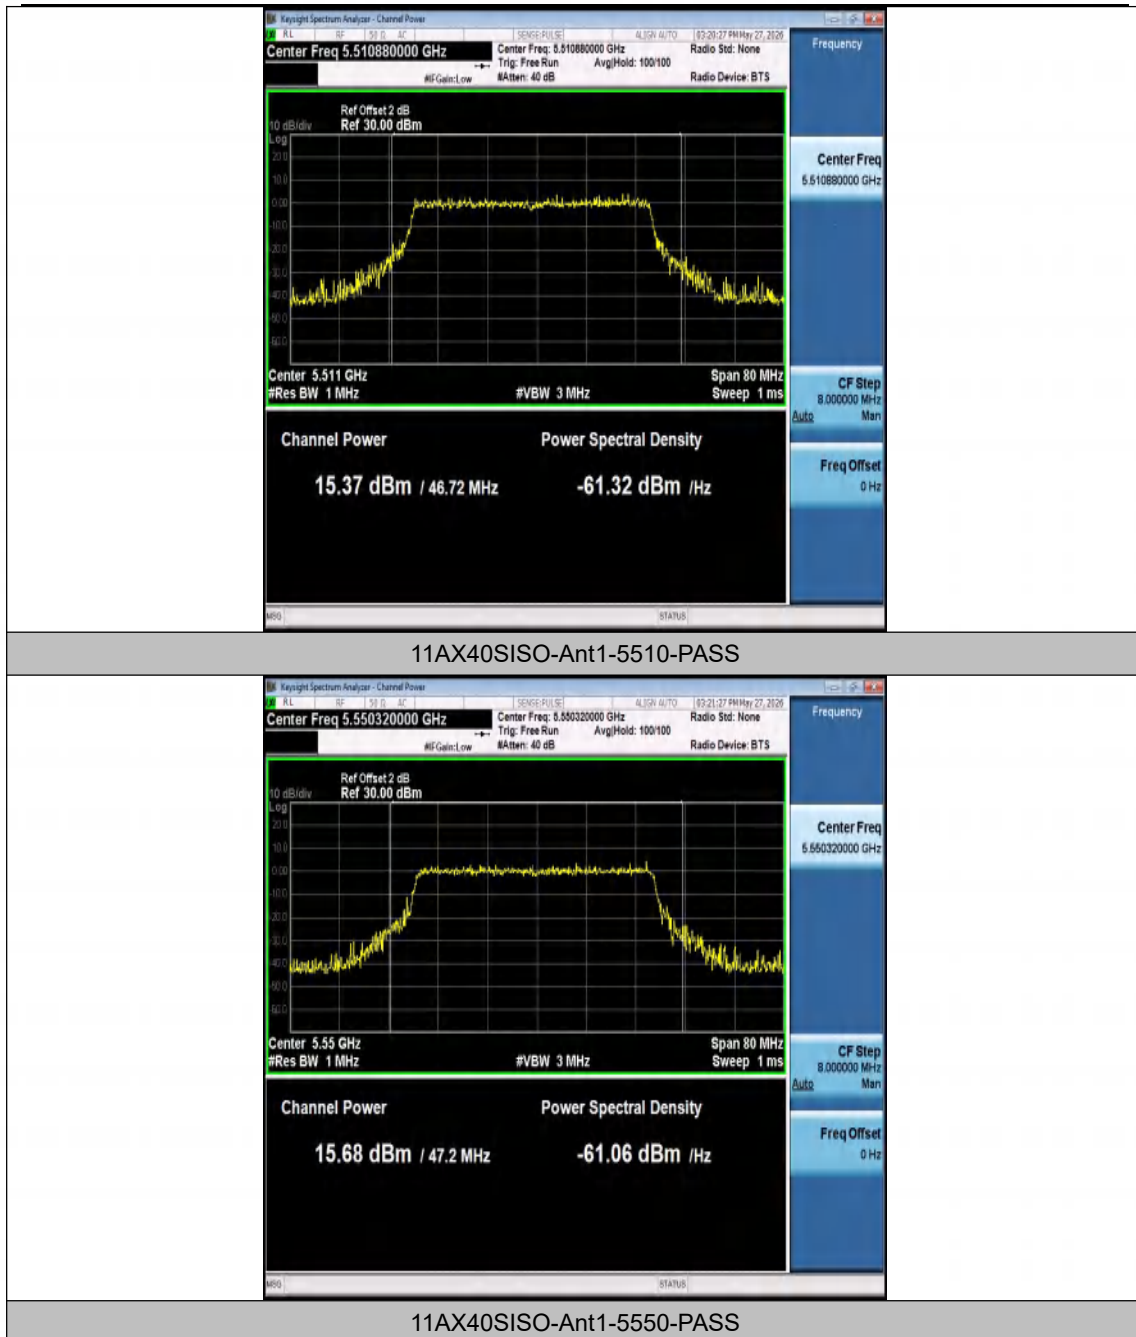

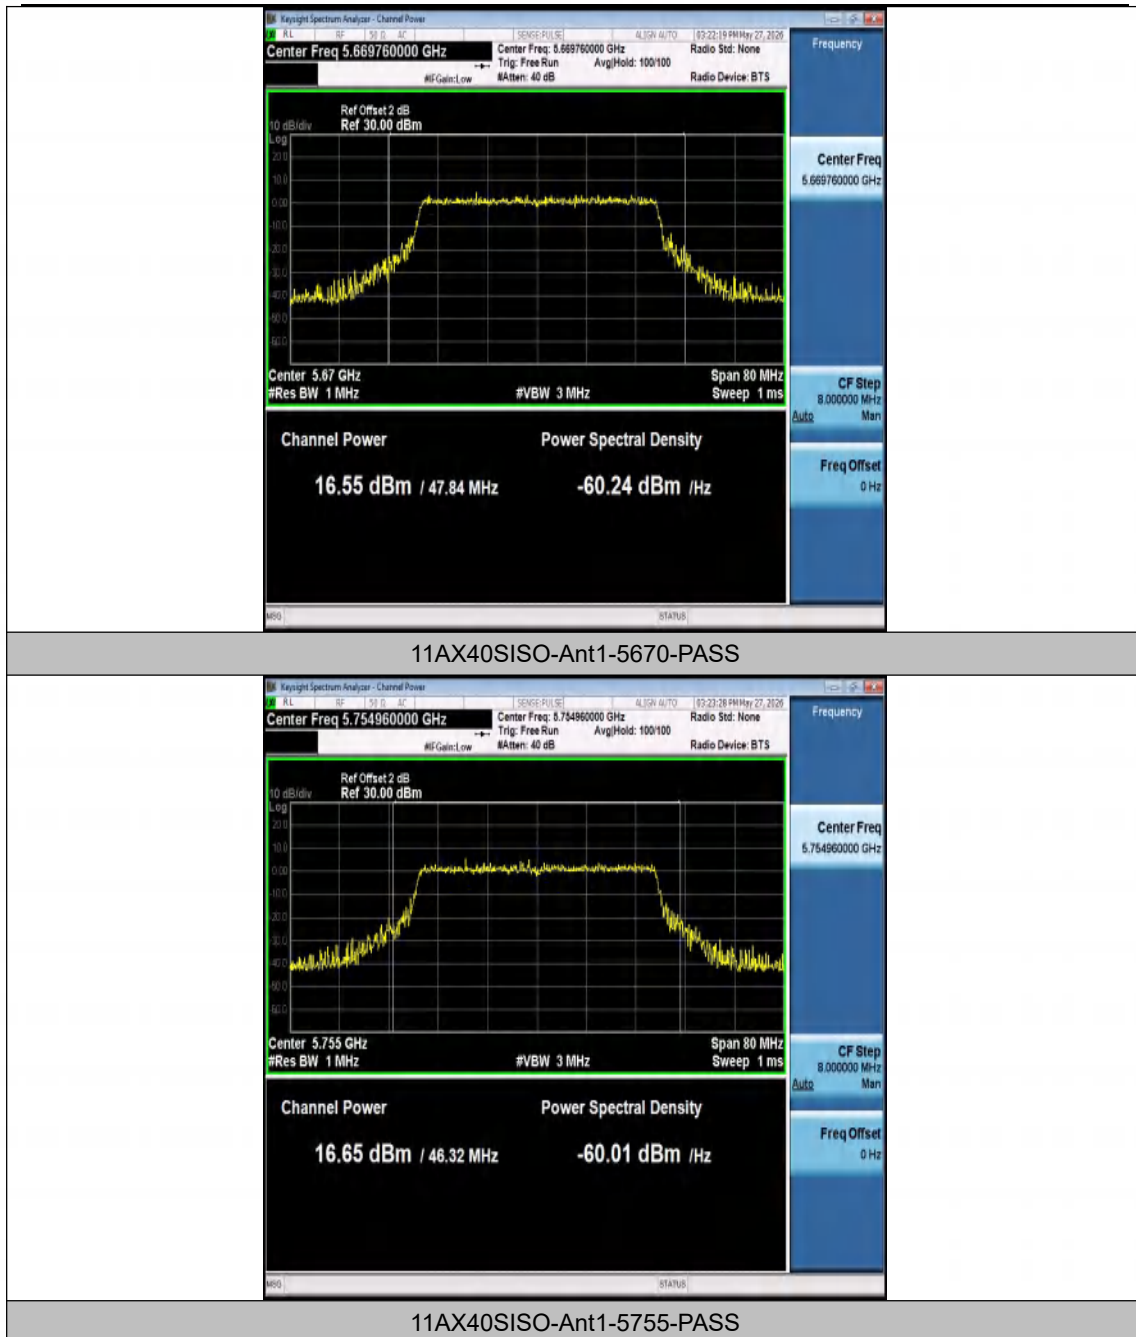

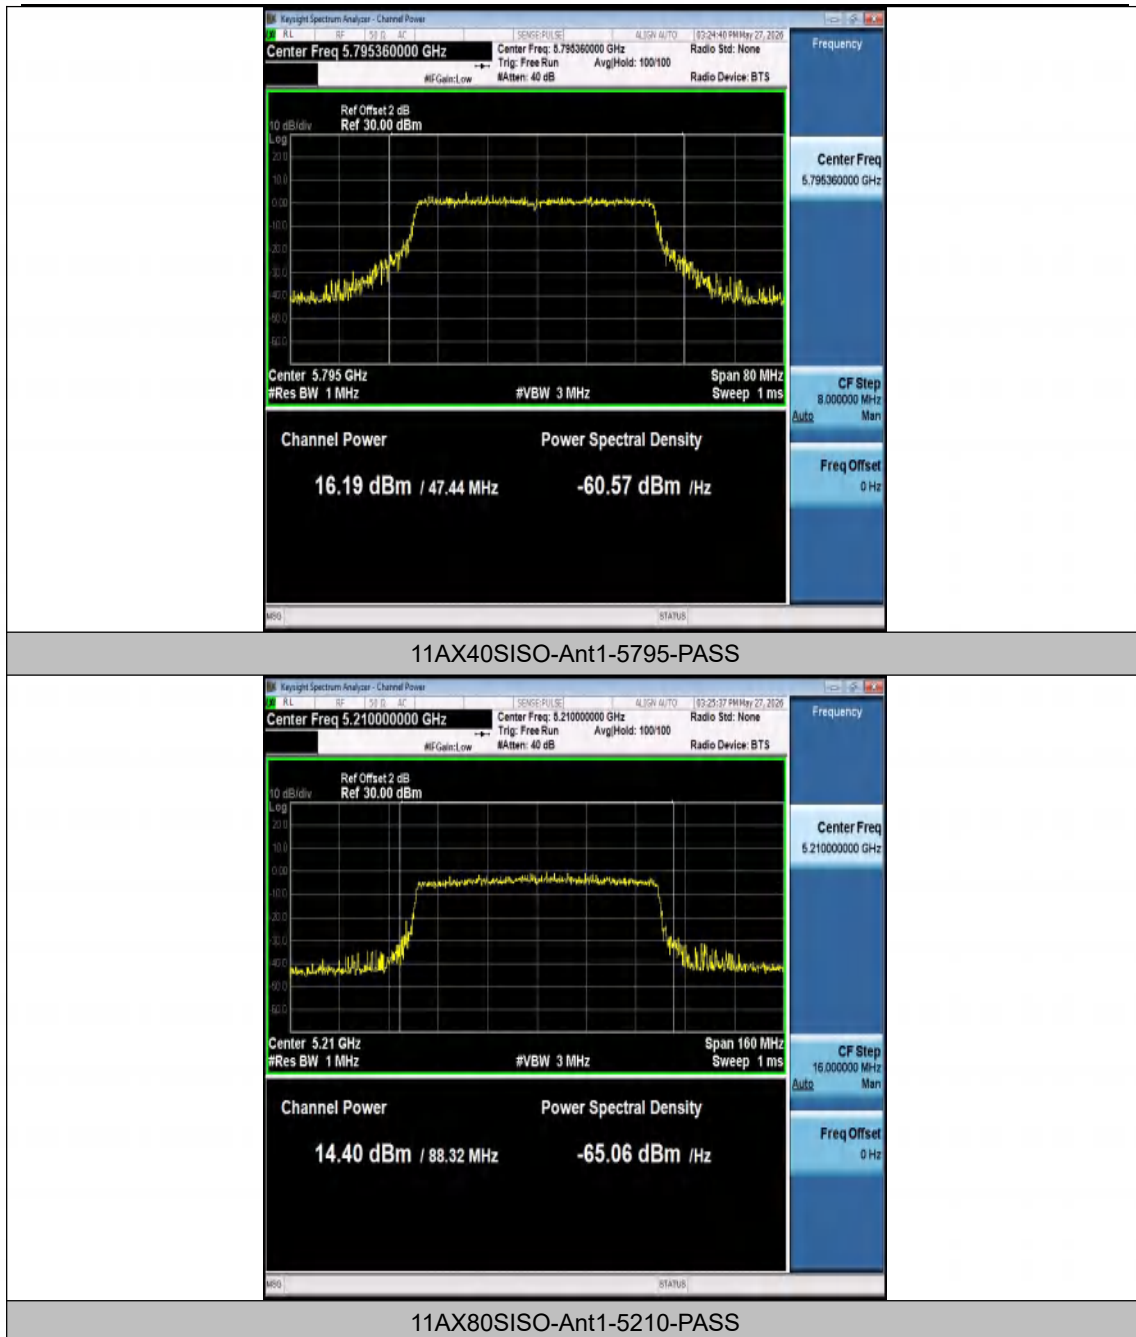

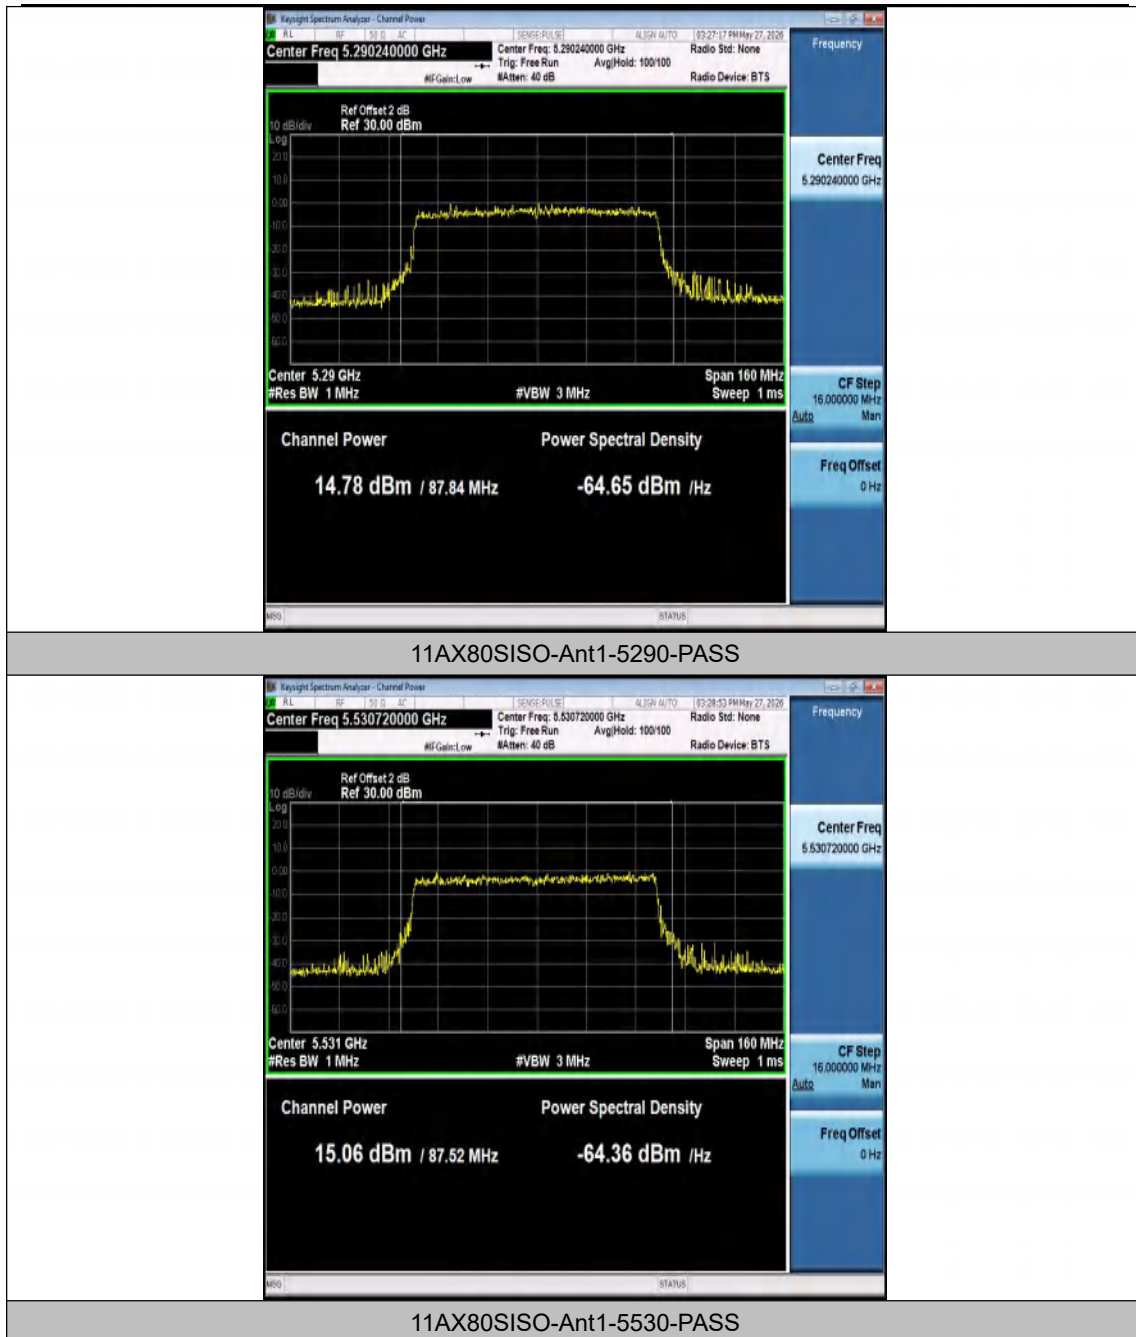

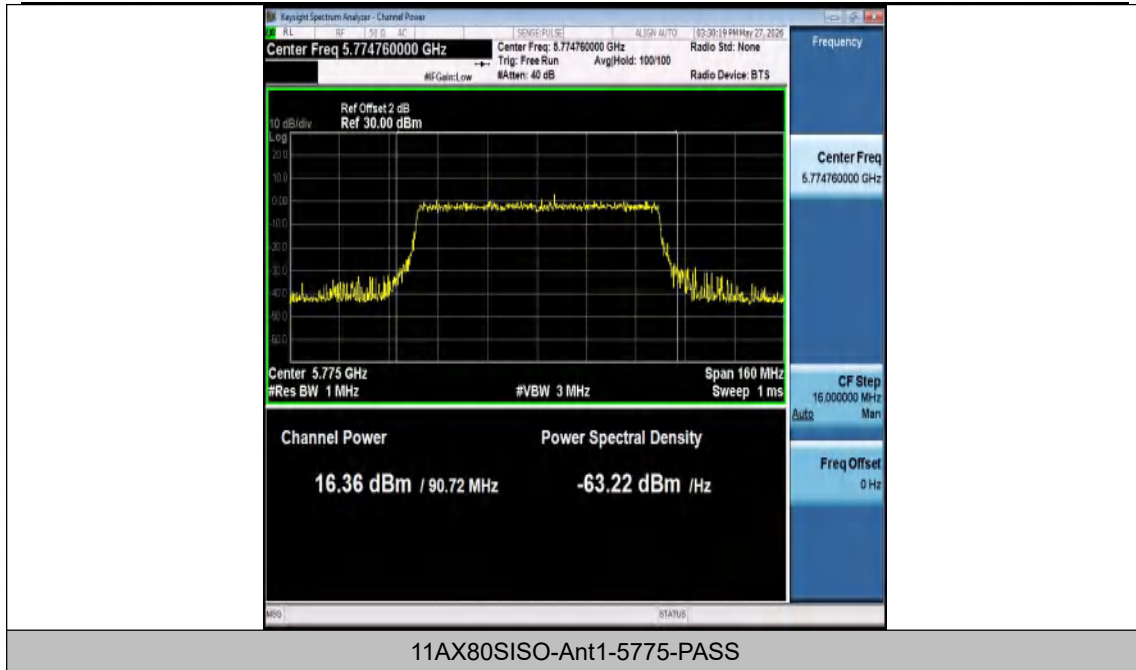

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix D: Maximum Power Spectral Density

Test Result B1/2/3

Test Mode	Antenna	Frequency[MHz]	Reading Result[dBm/MHz]	Result [dBm]	Limit [dBm/MHz]	Verdict
11A	Ant1	5180	-1.75	-1.75	≤11.00	PASS
11A	Ant1	5220	-2.09	-2.09	≤11.00	PASS
11A	Ant1	5240	-1.84	-1.84	≤11.00	PASS
11A	Ant1	5260	-1.55	-1.55	≤11.00	PASS
11A	Ant1	5300	-1.66	-1.66	≤11.00	PASS
11A	Ant1	5320	-1.23	-1.23	≤11.00	PASS
11A	Ant1	5500	-1.89	-1.89	≤11.00	PASS
11A	Ant1	5580	-0.88	-0.88	≤11.00	PASS
11A	Ant1	5700	-0.40	-0.40	≤11.00	PASS
11N20SISO	Ant1	5180	-2.43	-2.43	≤11.00	PASS
11N20SISO	Ant1	5220	-2.28	-2.28	≤11.00	PASS
11N20SISO	Ant1	5240	-2.67	-2.67	≤11.00	PASS
11N20SISO	Ant1	5260	-2.52	-2.52	≤11.00	PASS
11N20SISO	Ant1	5300	-1.81	-1.81	≤11.00	PASS
11N20SISO	Ant1	5320	-1.85	-1.85	≤11.00	PASS
11N20SISO	Ant1	5500	-2.11	-2.11	≤11.00	PASS
11N20SISO	Ant1	5580	-1.15	-1.15	≤11.00	PASS
11N20SISO	Ant1	5700	-0.66	-0.66	≤11.00	PASS
11N40SISO	Ant1	5190	-5.65	-5.65	≤11.00	PASS
11N40SISO	Ant1	5230	-5.91	-5.91	≤11.00	PASS
11N40SISO	Ant1	5270	-5.77	-5.77	≤11.00	PASS
11N40SISO	Ant1	5310	-5.06	-5.06	≤11.00	PASS
11N40SISO	Ant1	5510	-5.62	-5.62	≤11.00	PASS
11N40SISO	Ant1	5550	-4.89	-4.89	≤11.00	PASS
11N40SISO	Ant1	5670	-3.89	-3.89	≤11.00	PASS
11AC20SISO	Ant1	5180	-1.80	-1.80	≤11.00	PASS
11AC20SISO	Ant1	5220	-1.92	-1.92	≤11.00	PASS
11AC20SISO	Ant1	5240	-2.45	-2.45	≤11.00	PASS
11AC20SISO	Ant1	5260	-2.22	-2.22	≤11.00	PASS
11AC20SISO	Ant1	5300	-1.69	-1.69	≤11.00	PASS
11AC20SISO	Ant1	5320	-1.67	-1.67	≤11.00	PASS
11AC20SISO	Ant1	5500	-1.84	-1.84	≤11.00	PASS
11AC20SISO	Ant1	5580	-0.67	-0.67	≤11.00	PASS
11AC20SISO	Ant1	5700	-0.78	-0.78	≤11.00	PASS
11AC40SISO	Ant1	5190	-5.16	-5.16	≤11.00	PASS
11AC40SISO	Ant1	5230	-5.50	-5.50	≤11.00	PASS
11AC40SISO	Ant1	5270	-5.27	-5.27	≤11.00	PASS

11AC40SISO	Ant1	5310	-4.72	-4.72	≤11.00	PASS
11AC40SISO	Ant1	5510	-4.74	-4.74	≤11.00	PASS
11AC40SISO	Ant1	5550	-4.39	-4.39	≤11.00	PASS
11AC40SISO	Ant1	5670	-4.14	-4.14	≤11.00	PASS
11AC80SISO	Ant1	5210	-9.39	-9.39	≤11.00	PASS
11AC80SISO	Ant1	5290	-8.76	-8.76	≤11.00	PASS
11AC80SISO	Ant1	5530	-9.90	-9.90	≤11.00	PASS
11AX20SISO	Ant1	5180	-2.25	-2.25	≤11.00	PASS
11AX20SISO	Ant1	5220	-2.27	-2.27	≤11.00	PASS
11AX20SISO	Ant1	5240	-2.31	-2.31	≤11.00	PASS
11AX20SISO	Ant1	5260	-2.55	-2.55	≤11.00	PASS
11AX20SISO	Ant1	5300	-2.27	-2.27	≤11.00	PASS
11AX20SISO	Ant1	5320	-1.88	-1.88	≤11.00	PASS
11AX20SISO	Ant1	5500	-2.27	-2.27	≤11.00	PASS
11AX20SISO	Ant1	5580	-1.19	-1.19	≤11.00	PASS
11AX20SISO	Ant1	5700	-1.22	-1.22	≤11.00	PASS
11AX40SISO	Ant1	5190	-5.45	-5.45	≤11.00	PASS
11AX40SISO	Ant1	5230	-5.64	-5.64	≤11.00	PASS
11AX40SISO	Ant1	5270	-5.54	-5.54	≤11.00	PASS
11AX40SISO	Ant1	5310	-5.31	-5.31	≤11.00	PASS
11AX40SISO	Ant1	5510	-5.22	-5.22	≤11.00	PASS
11AX40SISO	Ant1	5550	-4.83	-4.83	≤11.00	PASS
11AX40SISO	Ant1	5670	-4.09	-4.09	≤11.00	PASS
11AX80SISO	Ant1	5210	-8.75	-8.75	≤11.00	PASS
11AX80SISO	Ant1	5290	-9.39	-9.39	≤11.00	PASS
11AX80SISO	Ant1	5530	-9.20	-9.20	≤11.00	PASS

Note: 1.The cable loss are compensated in the graph.

Test Result B4


Test Mode	Antenna	Frequency[MHz]	Result [dBm/500KHz]	Limit [dBm/500KHz]	Verdict
11A	Ant1	5745	-3.05	≤30.00	PASS
11A	Ant1	5785	-3.50	≤30.00	PASS
11A	Ant1	5825	-3.75	≤30.00	PASS
11N20SISO	Ant1	5745	-3.10	≤30.00	PASS
11N20SISO	Ant1	5785	-3.90	≤30.00	PASS
11N20SISO	Ant1	5825	-4.10	≤30.00	PASS
11N40SISO	Ant1	5755	-5.98	≤30.00	PASS
11N40SISO	Ant1	5795	-6.72	≤30.00	PASS
11AC20SISO	Ant1	5745	-3.30	≤30.00	PASS
11AC20SISO	Ant1	5785	-3.36	≤30.00	PASS
11AC20SISO	Ant1	5825	-3.78	≤30.00	PASS
11AC40SISO	Ant1	5755	-6.68	≤30.00	PASS
11AC40SISO	Ant1	5795	-7.04	≤30.00	PASS
11AC80SISO	Ant1	5775	-10.68	≤30.00	PASS
11AX20SISO	Ant1	5745	-3.27	≤30.00	PASS
11AX20SISO	Ant1	5785	-3.86	≤30.00	PASS
11AX20SISO	Ant1	5825	-4.19	≤30.00	PASS
11AX40SISO	Ant1	5755	-6.66	≤30.00	PASS
11AX40SISO	Ant1	5795	-7.25	≤30.00	PASS
11AX80SISO	Ant1	5775	-10.70	≤30.00	PASS

Note:

1.The cable loss and RBW Factor are compensated in the graph.

2.Offset=cable loss(2dB) + RBW Factor (-0.09dB)


Test Graphs B1/2/3

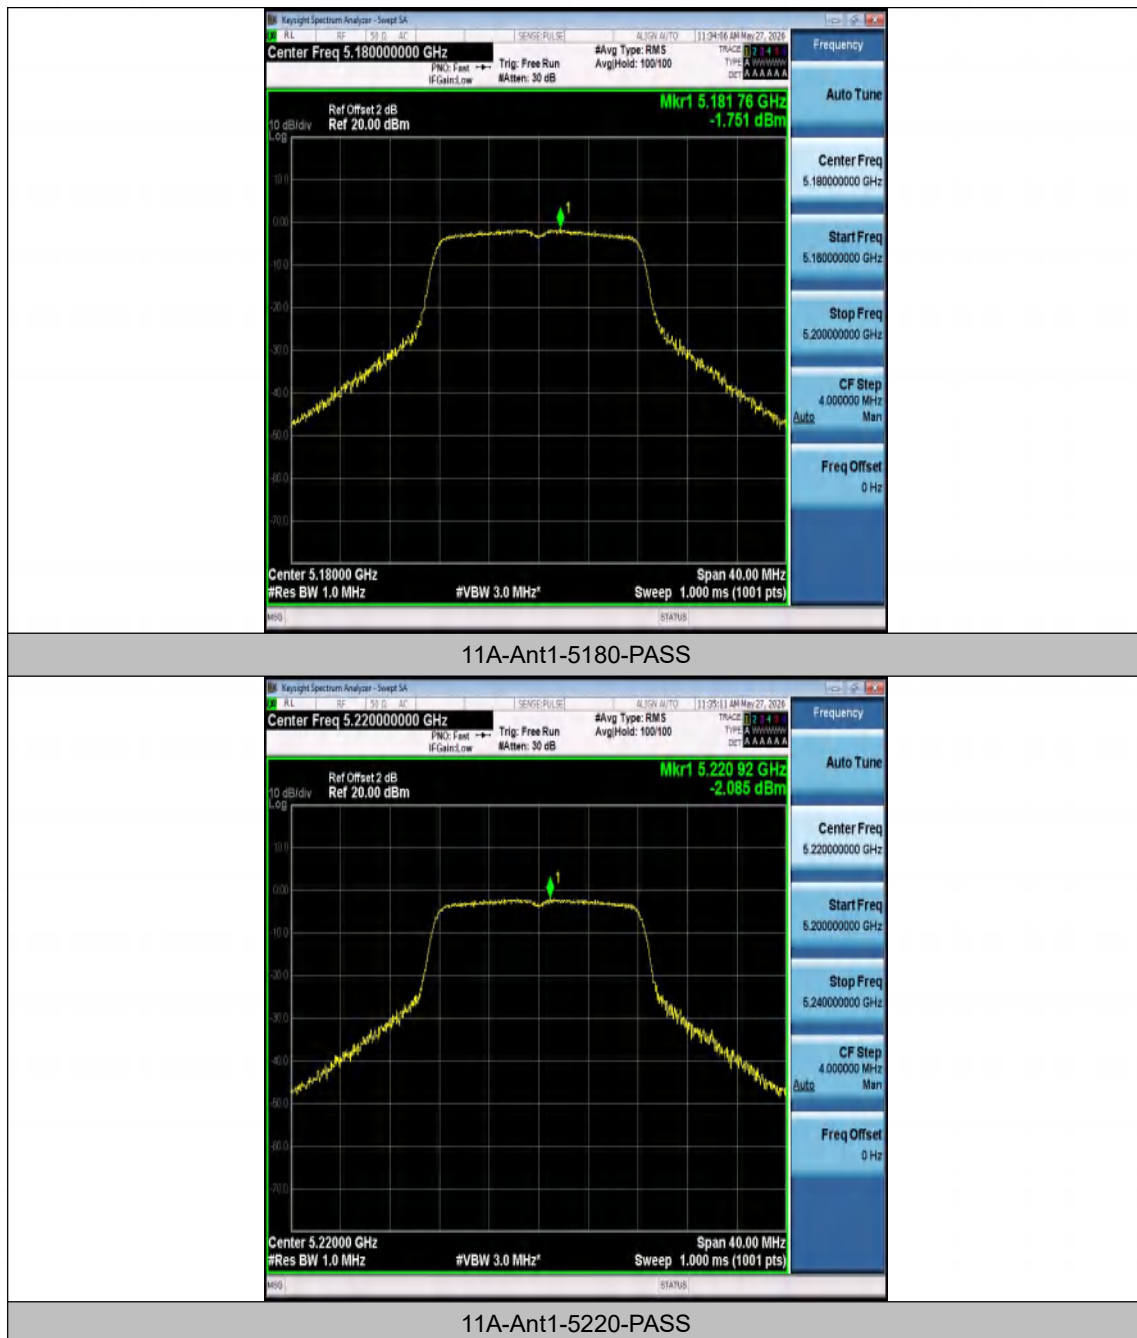

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

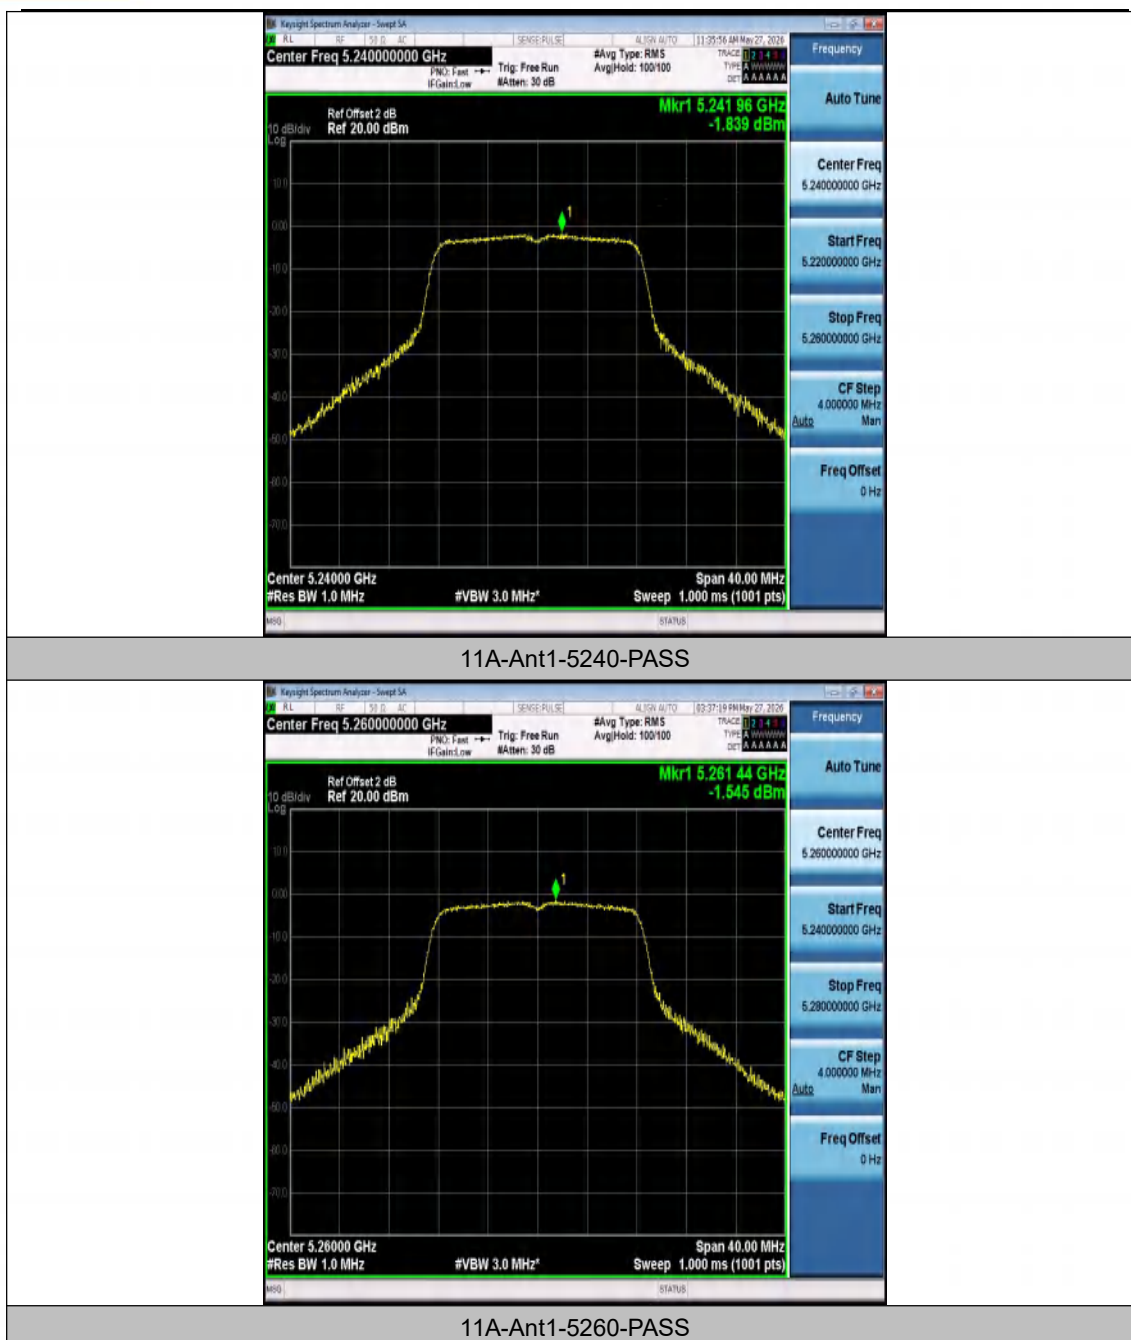

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

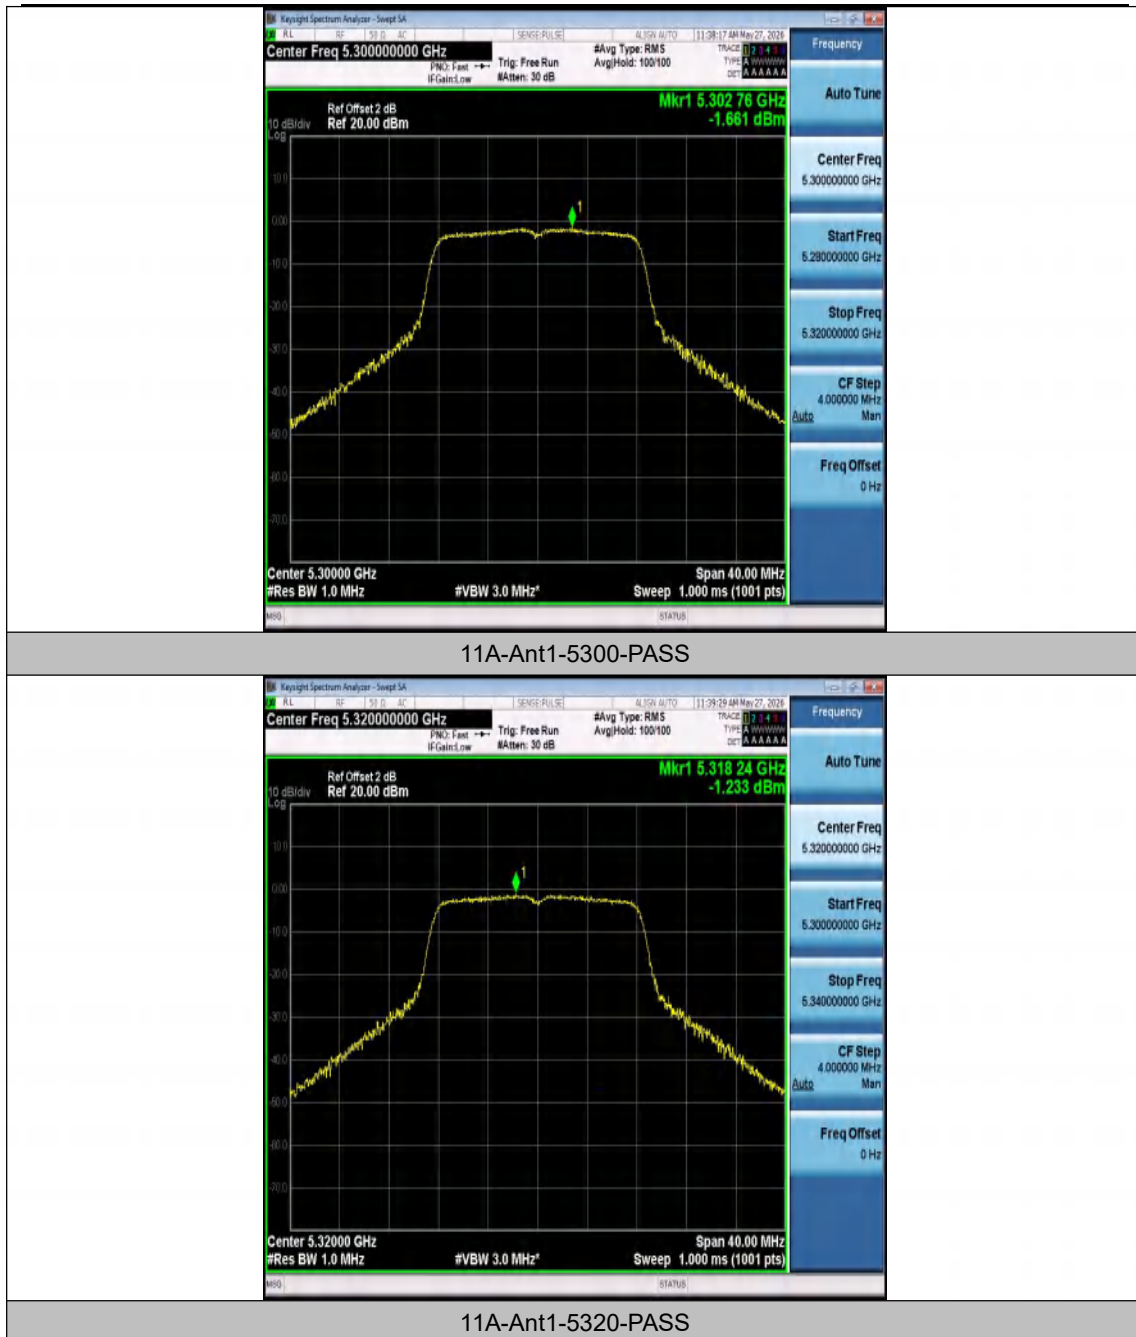

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

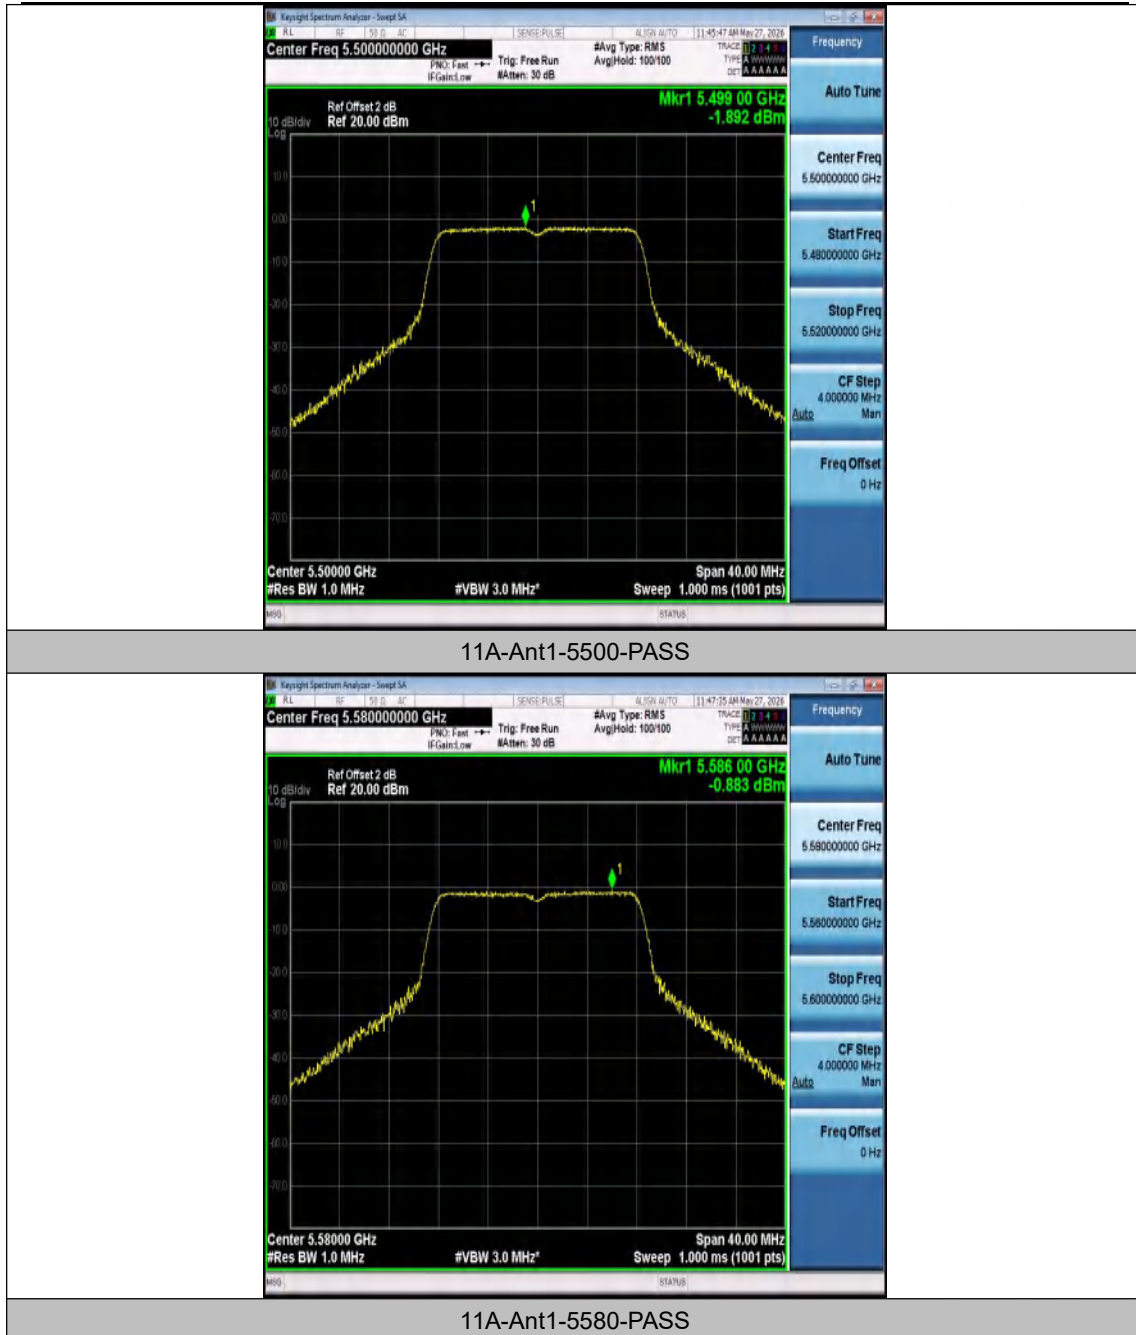

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

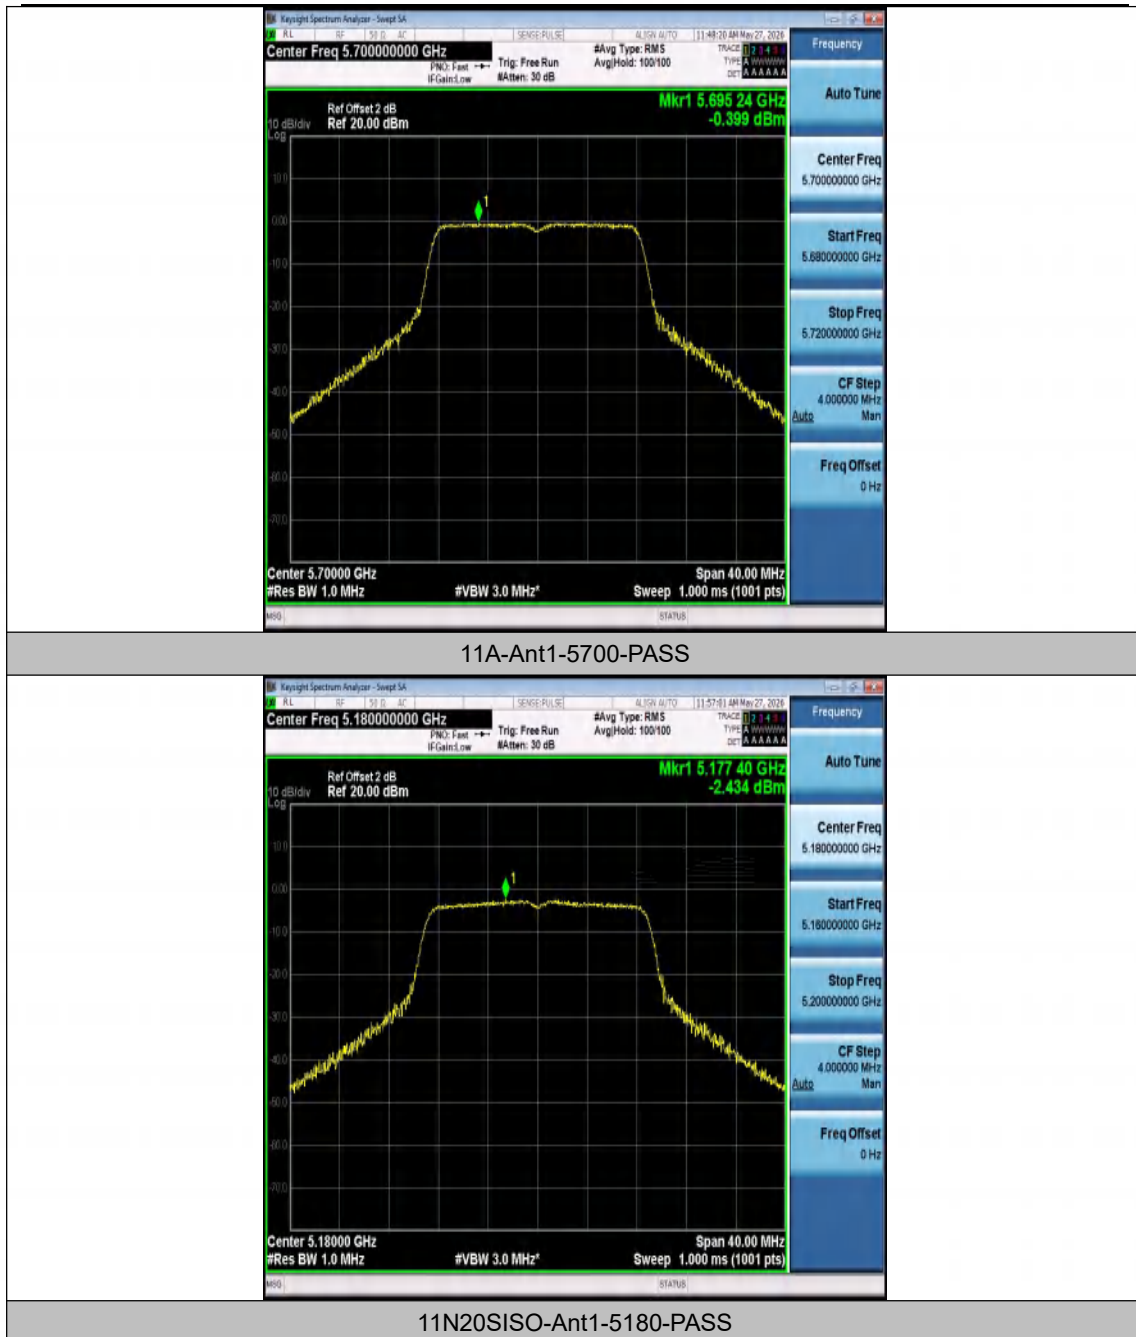

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

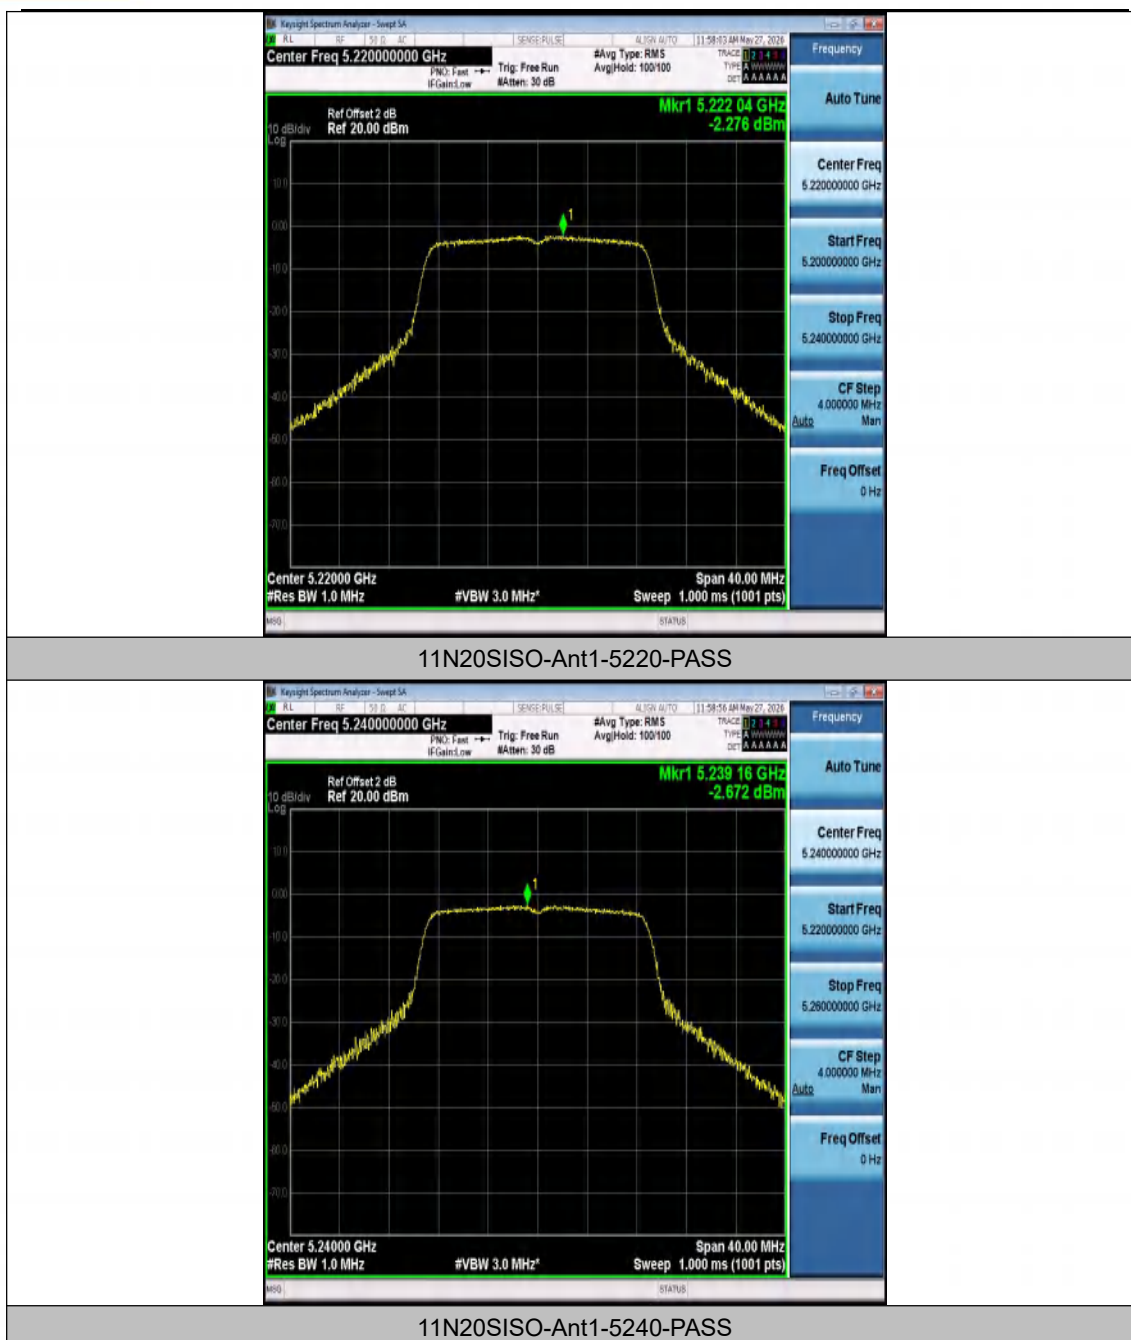

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

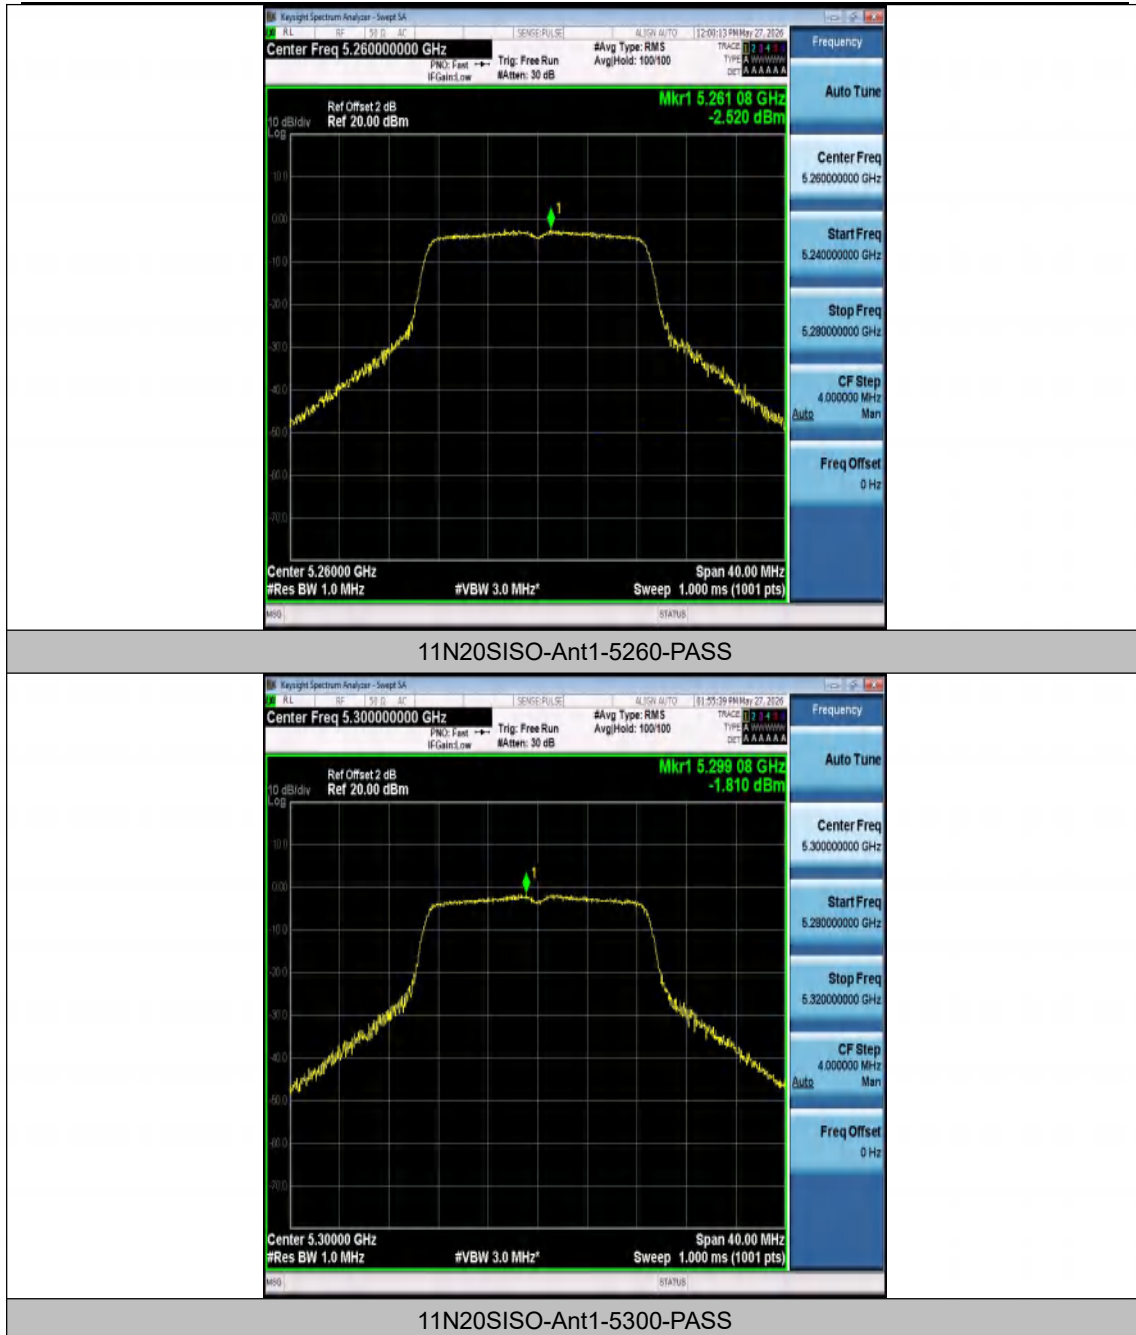


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

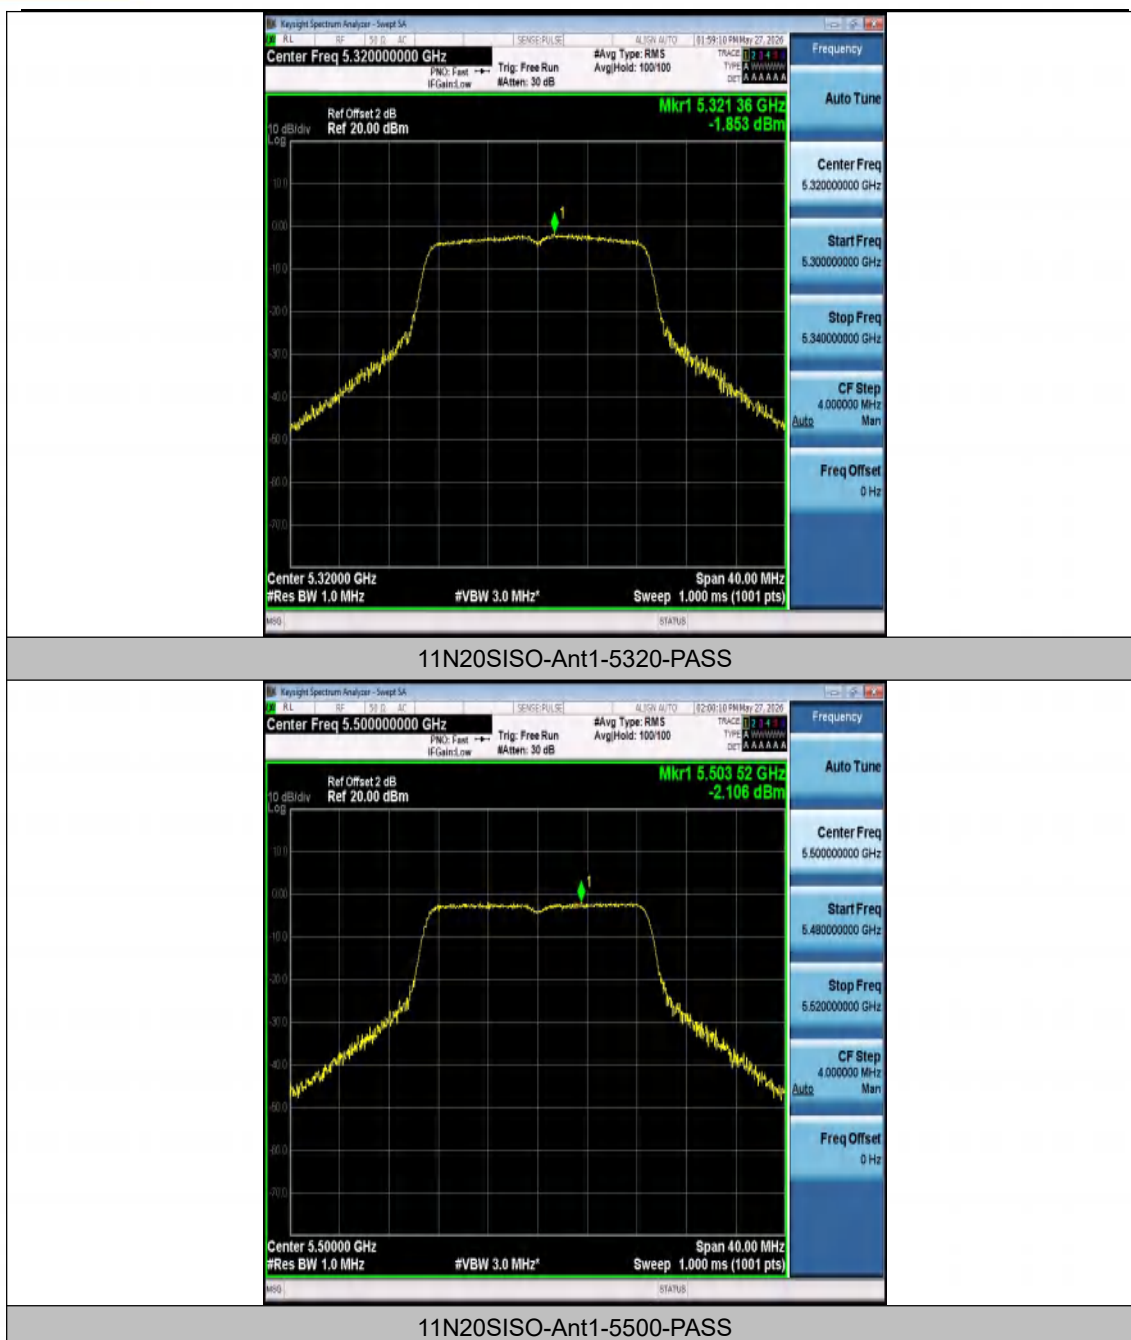


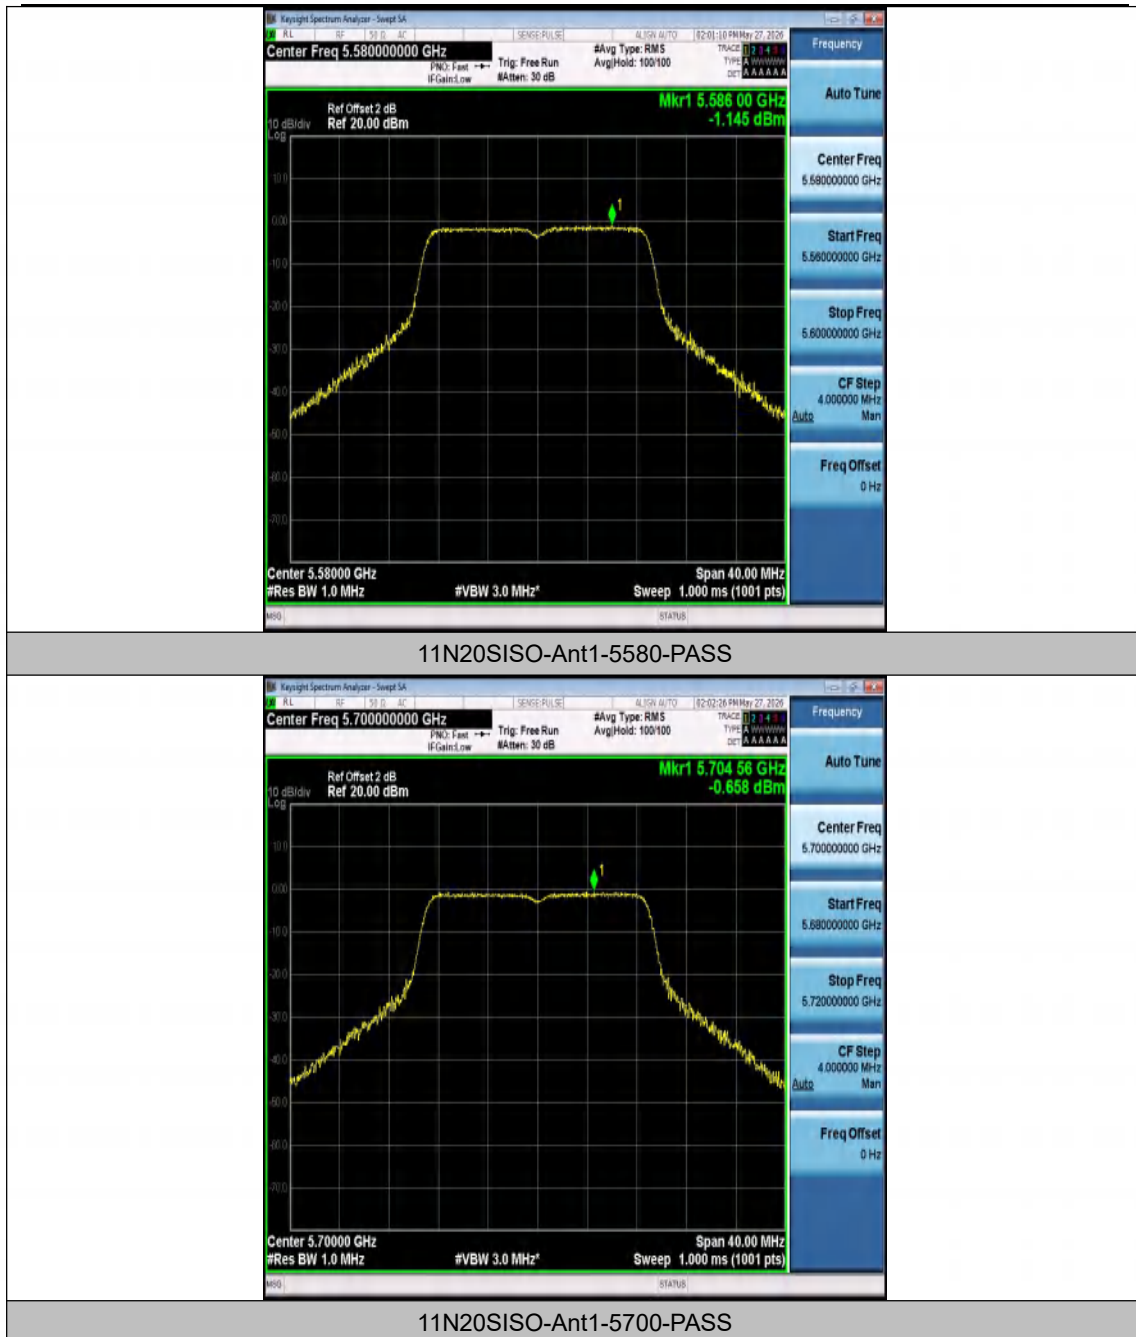

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

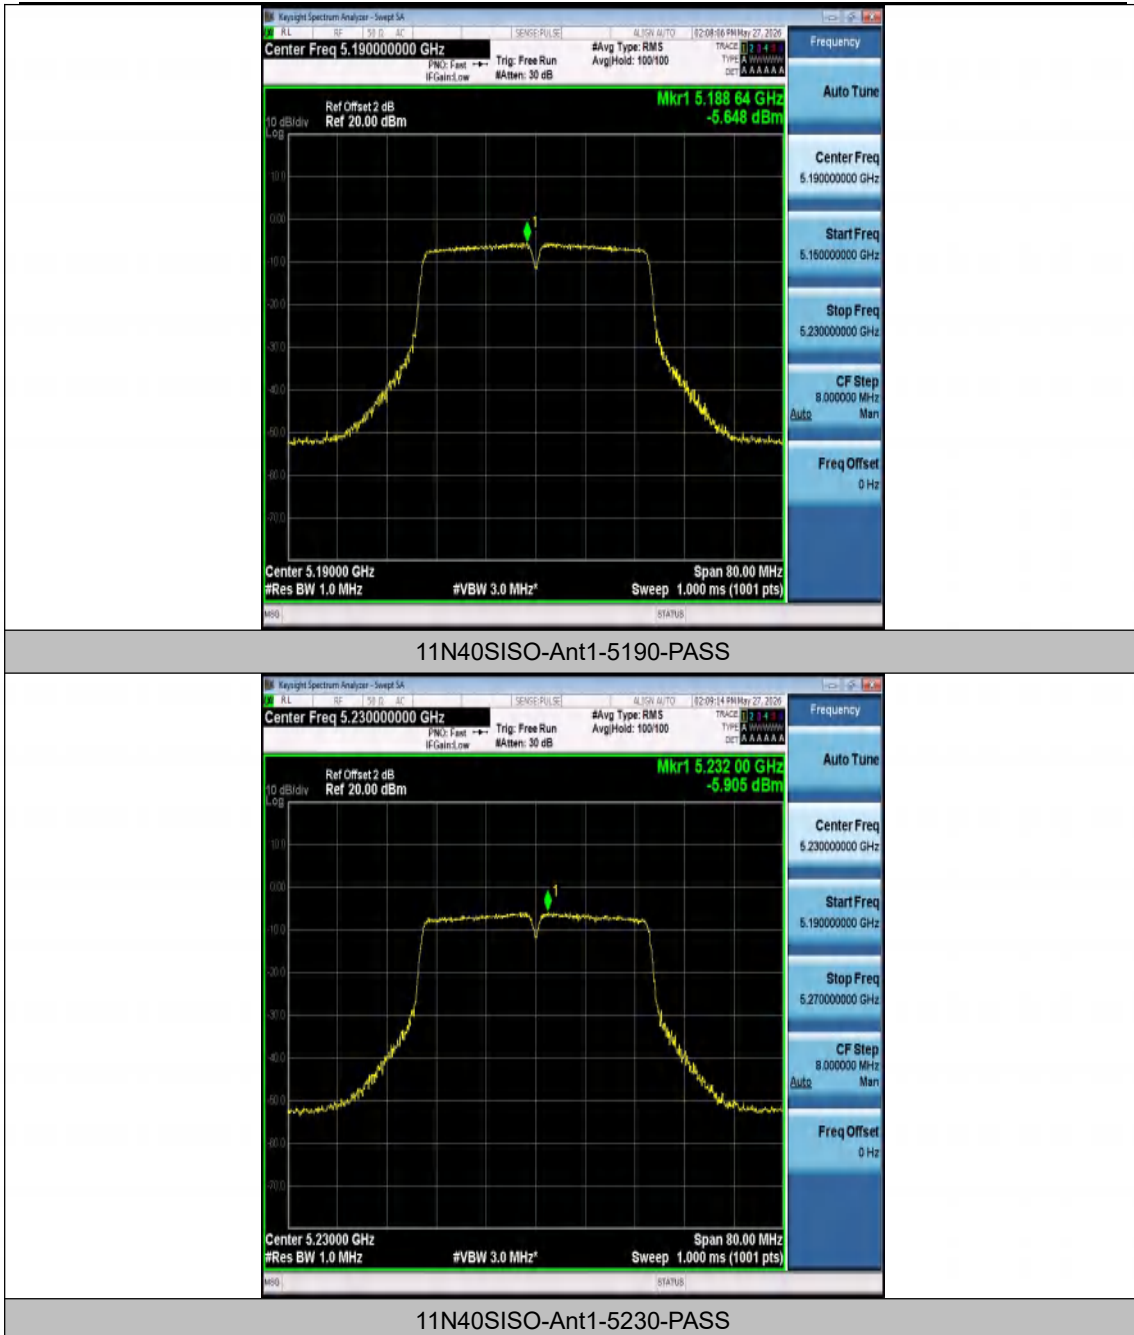

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

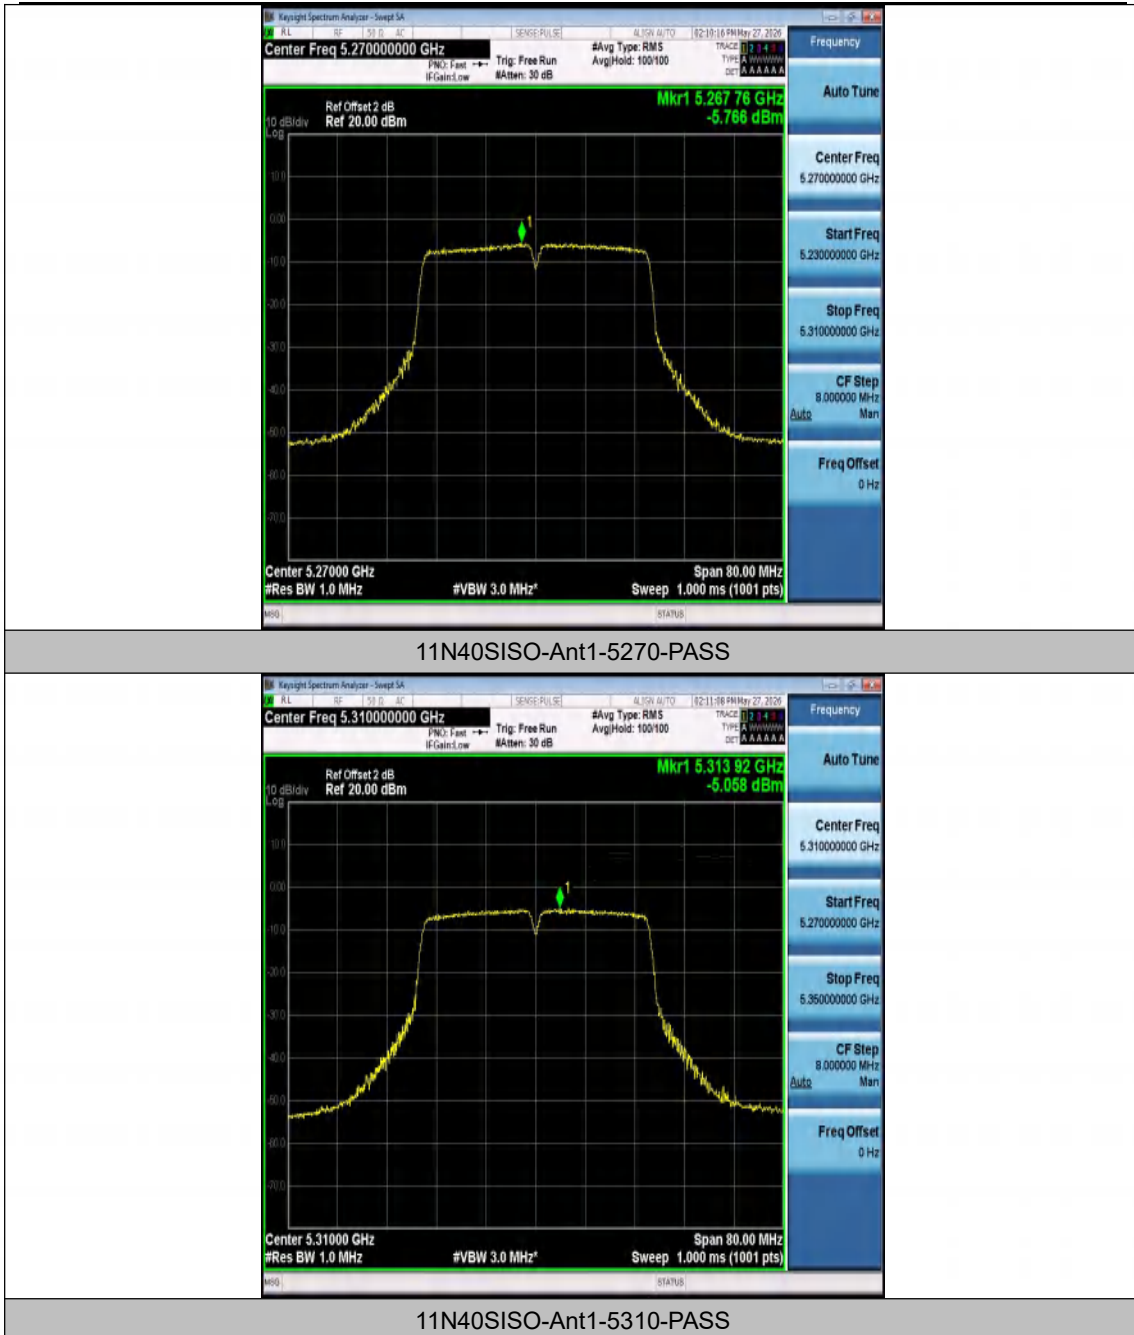

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

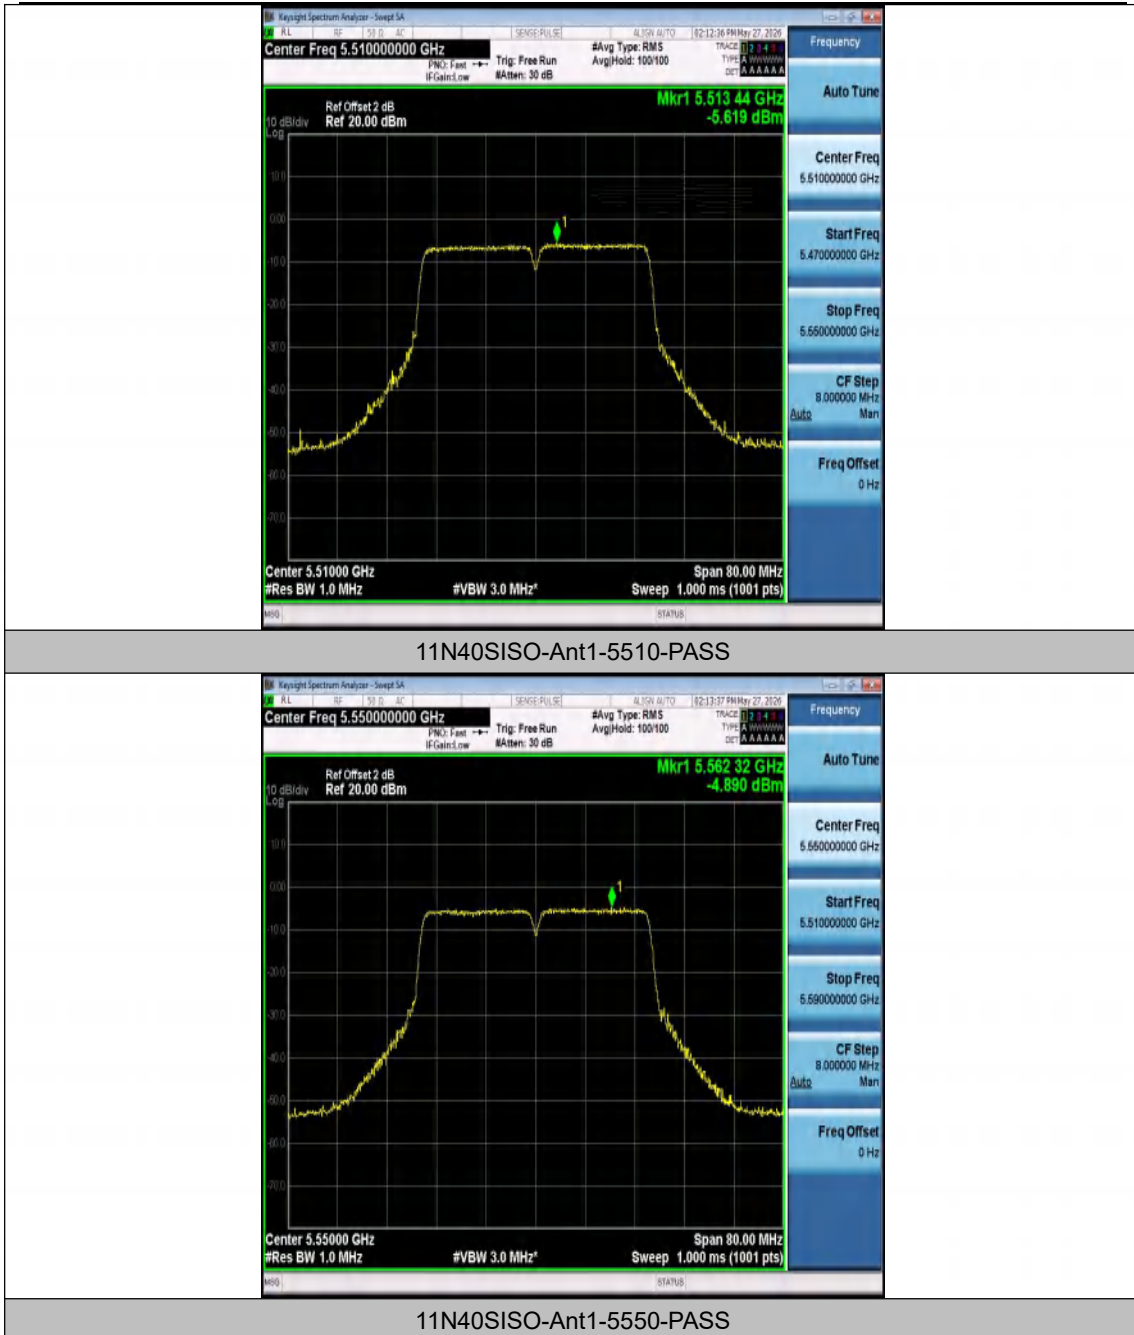


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

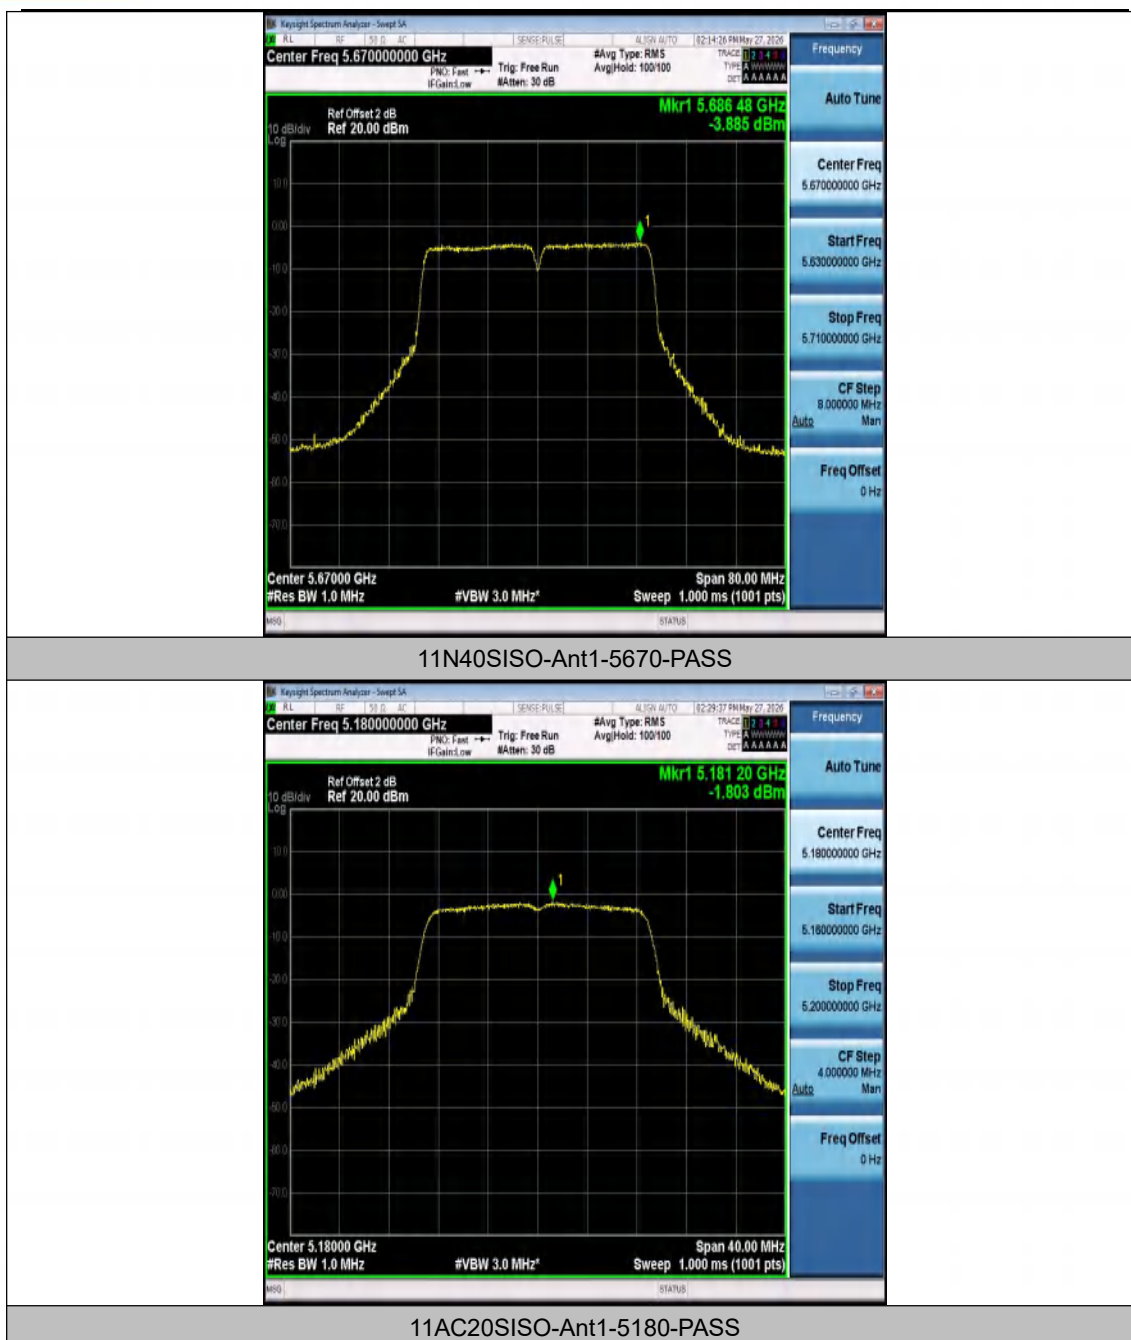


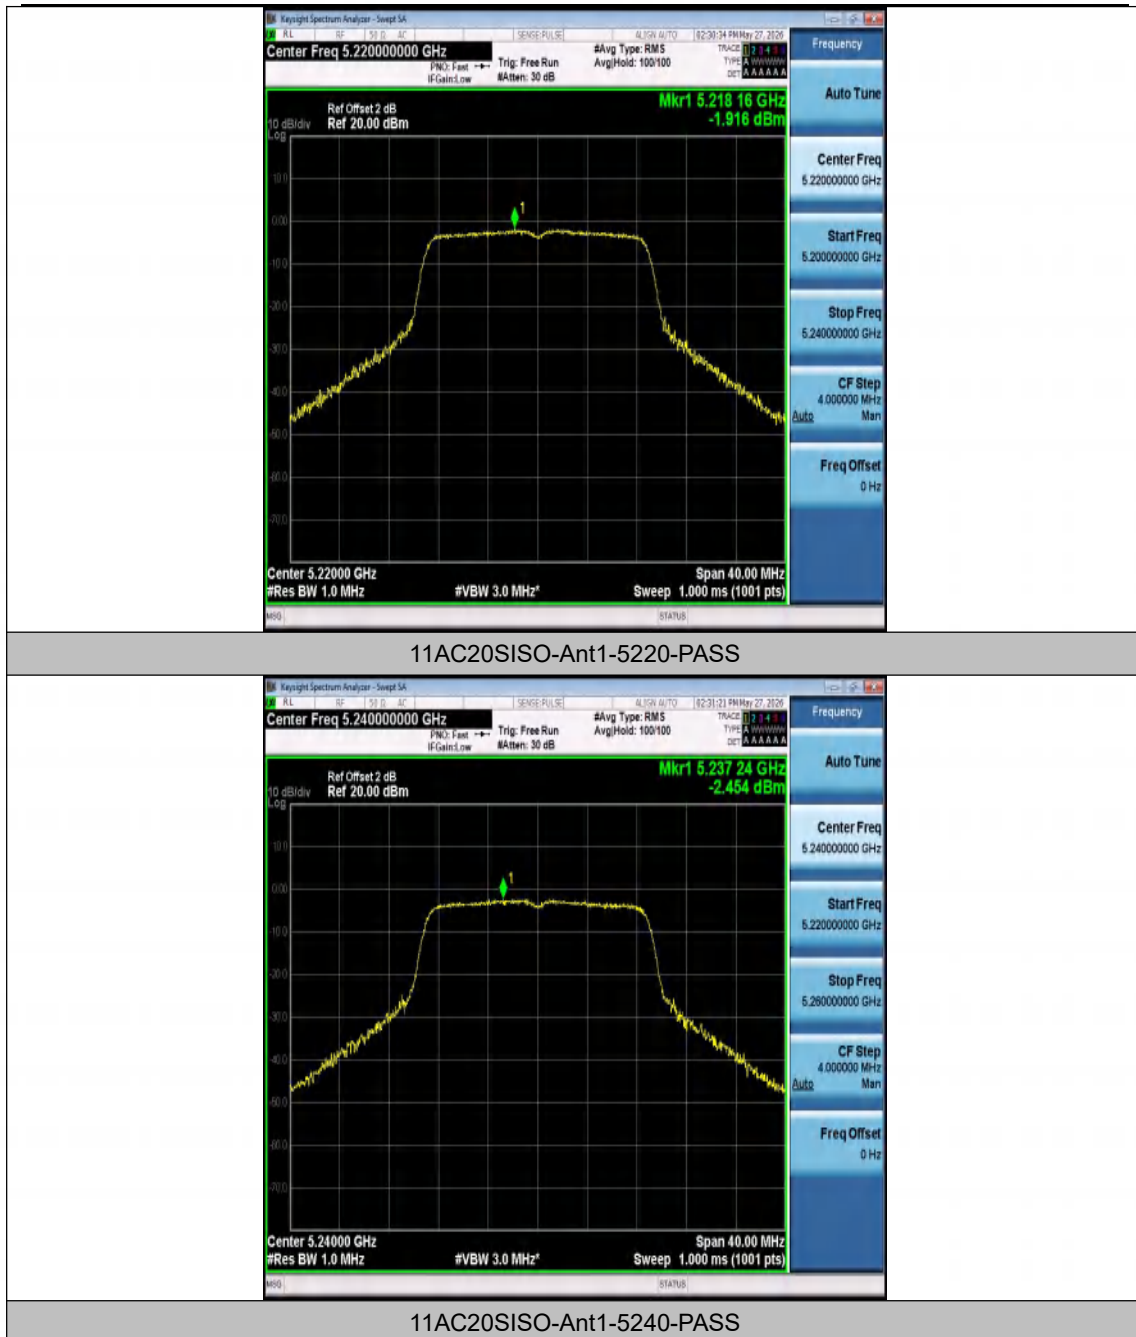

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

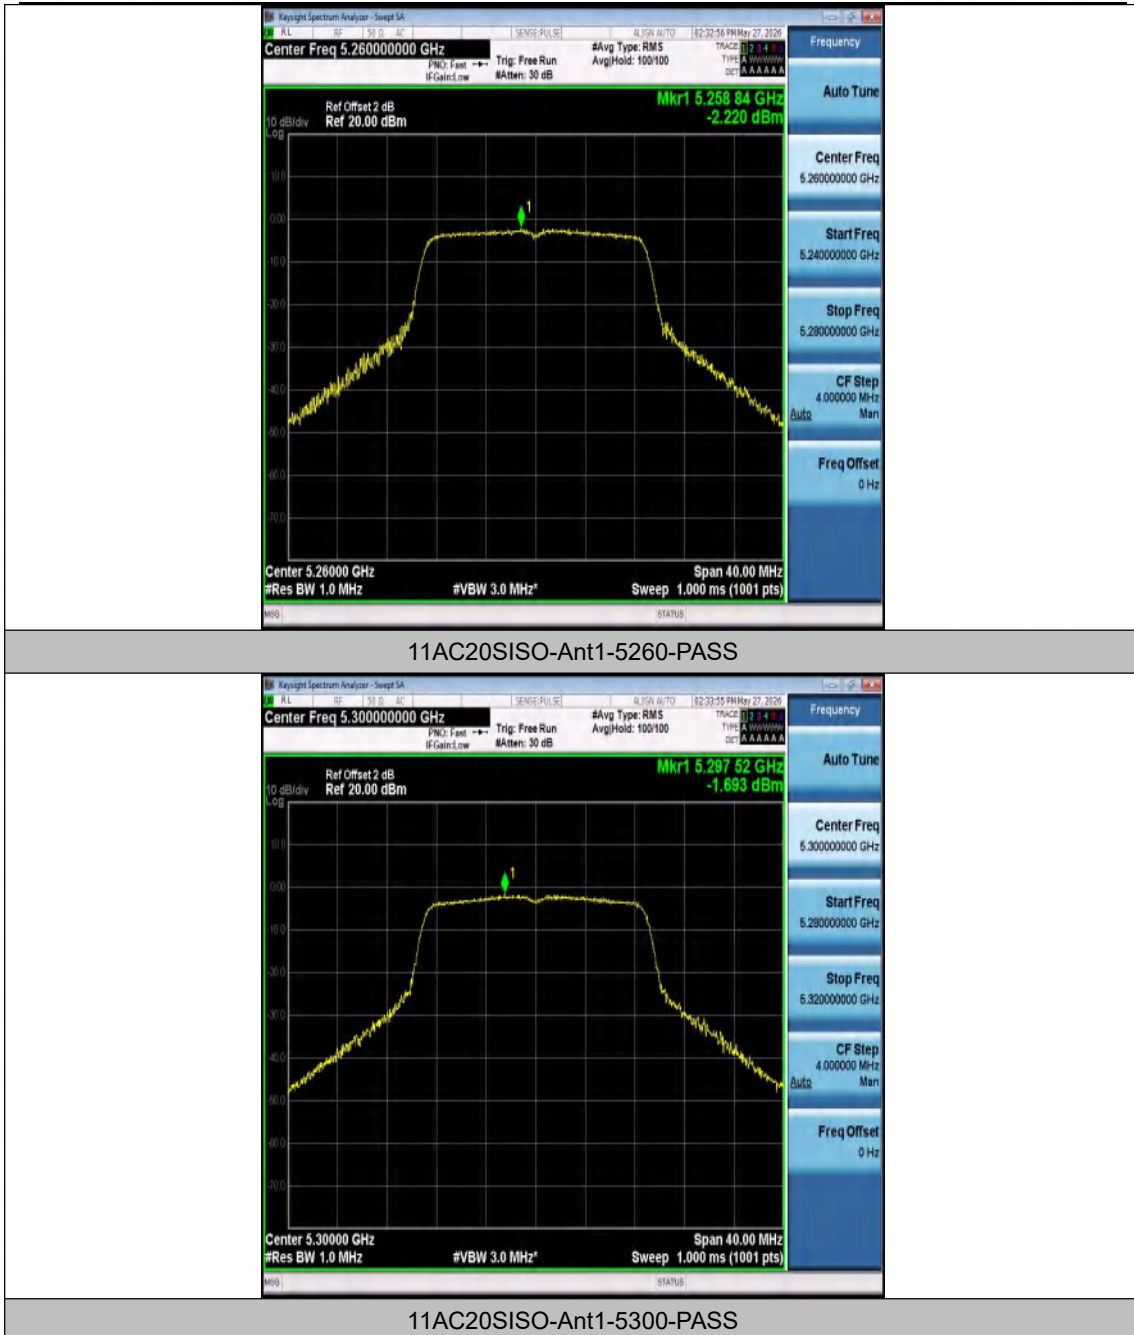

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

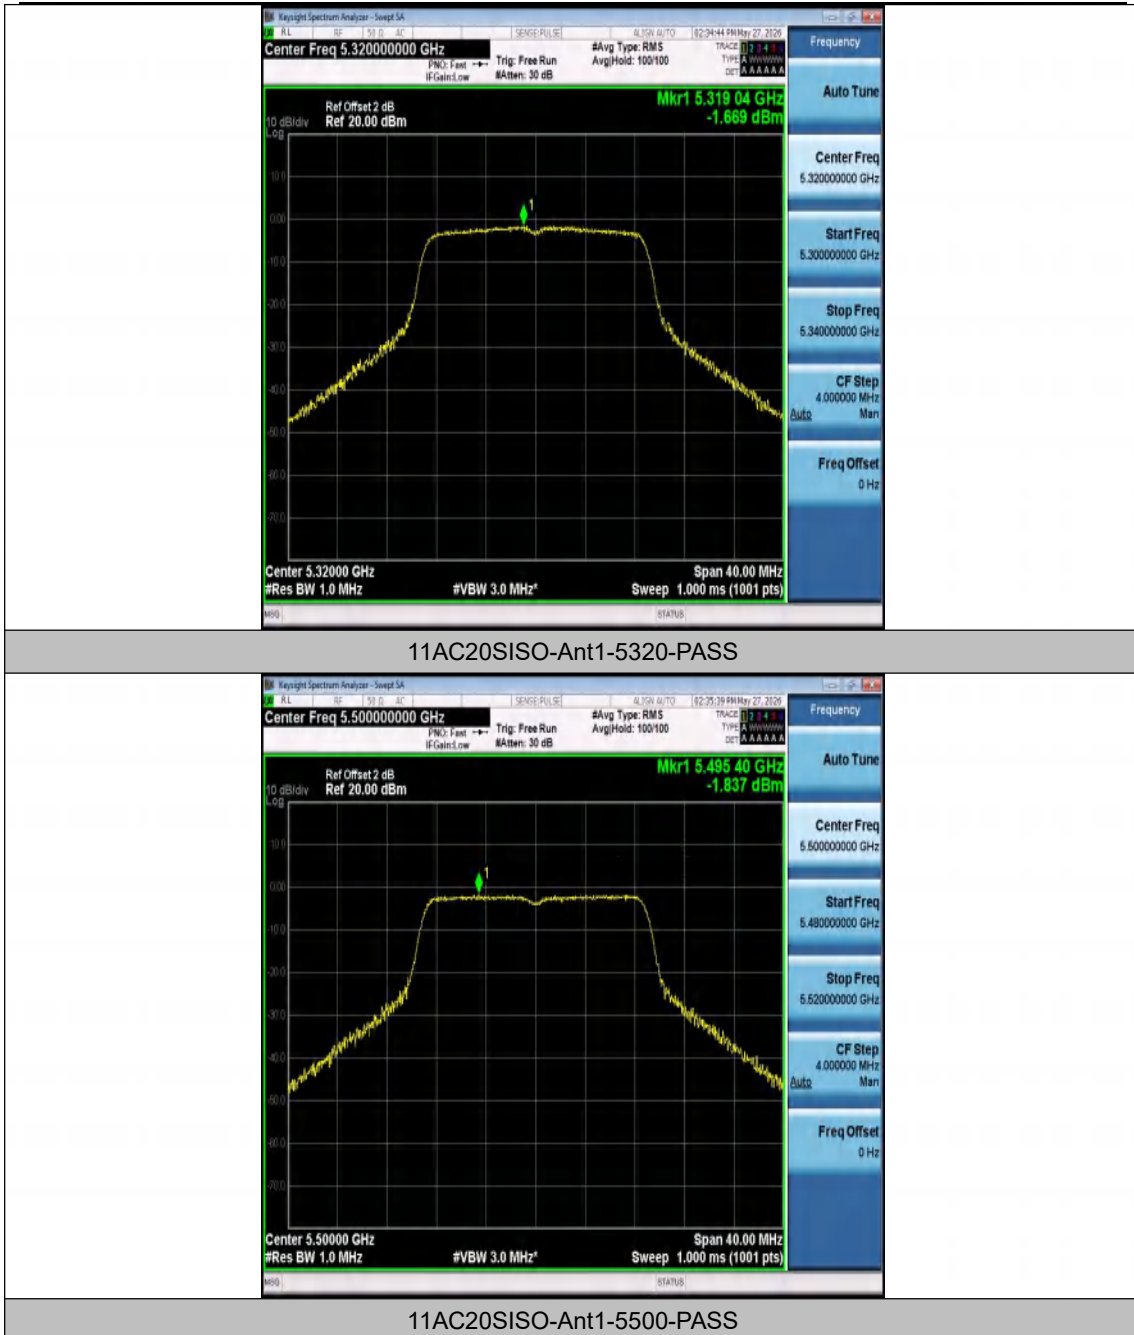

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

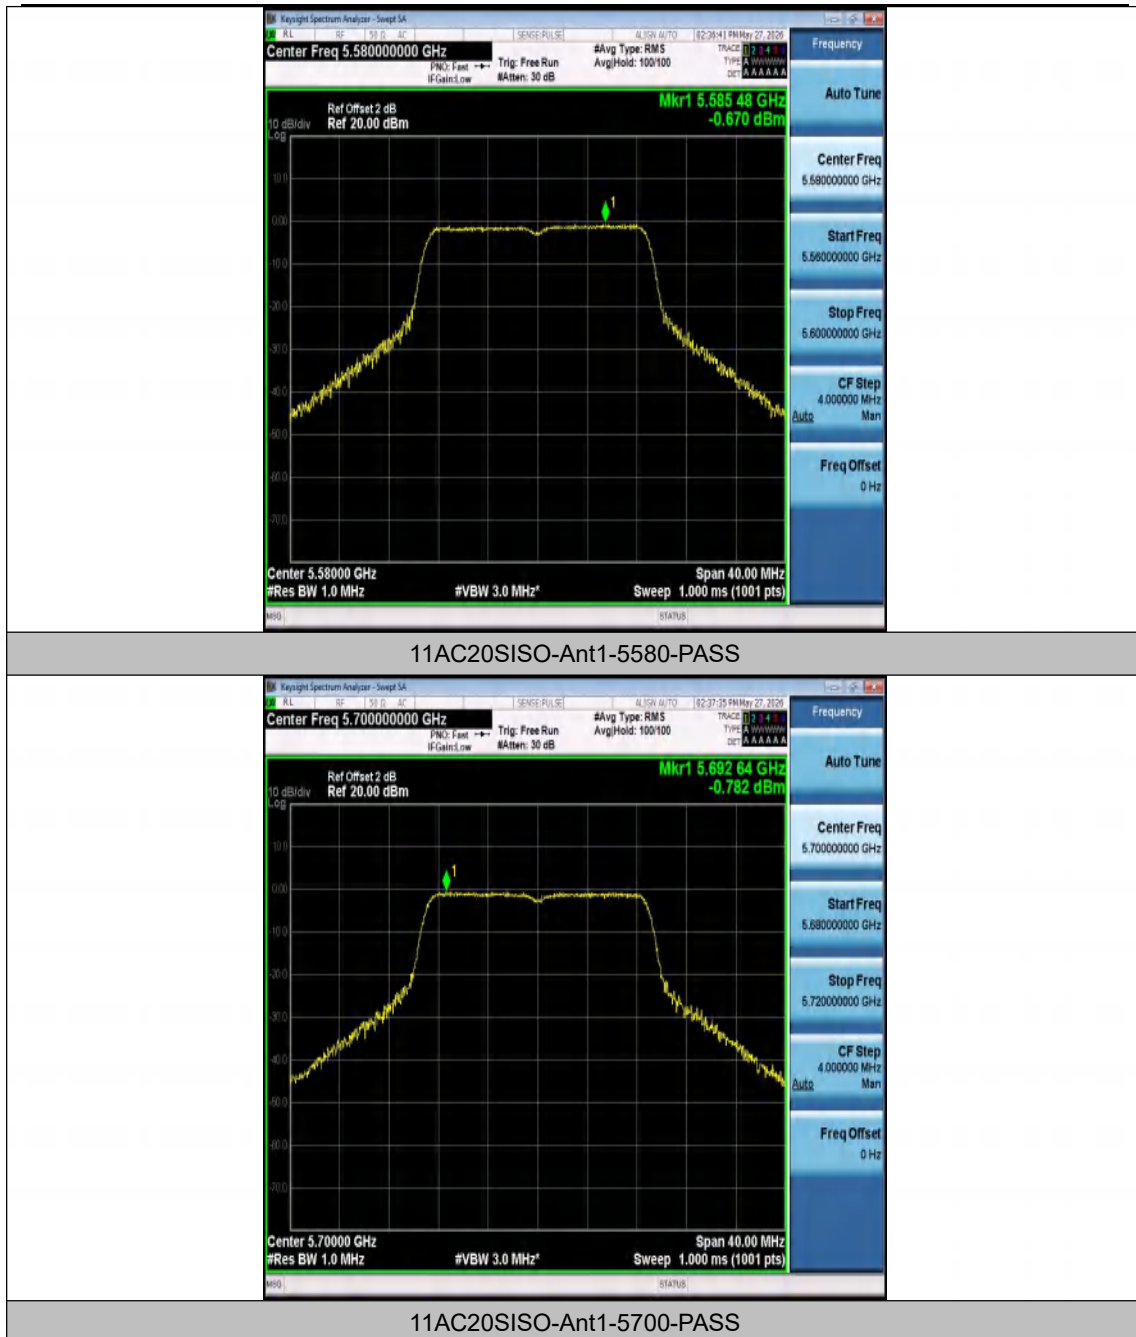

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

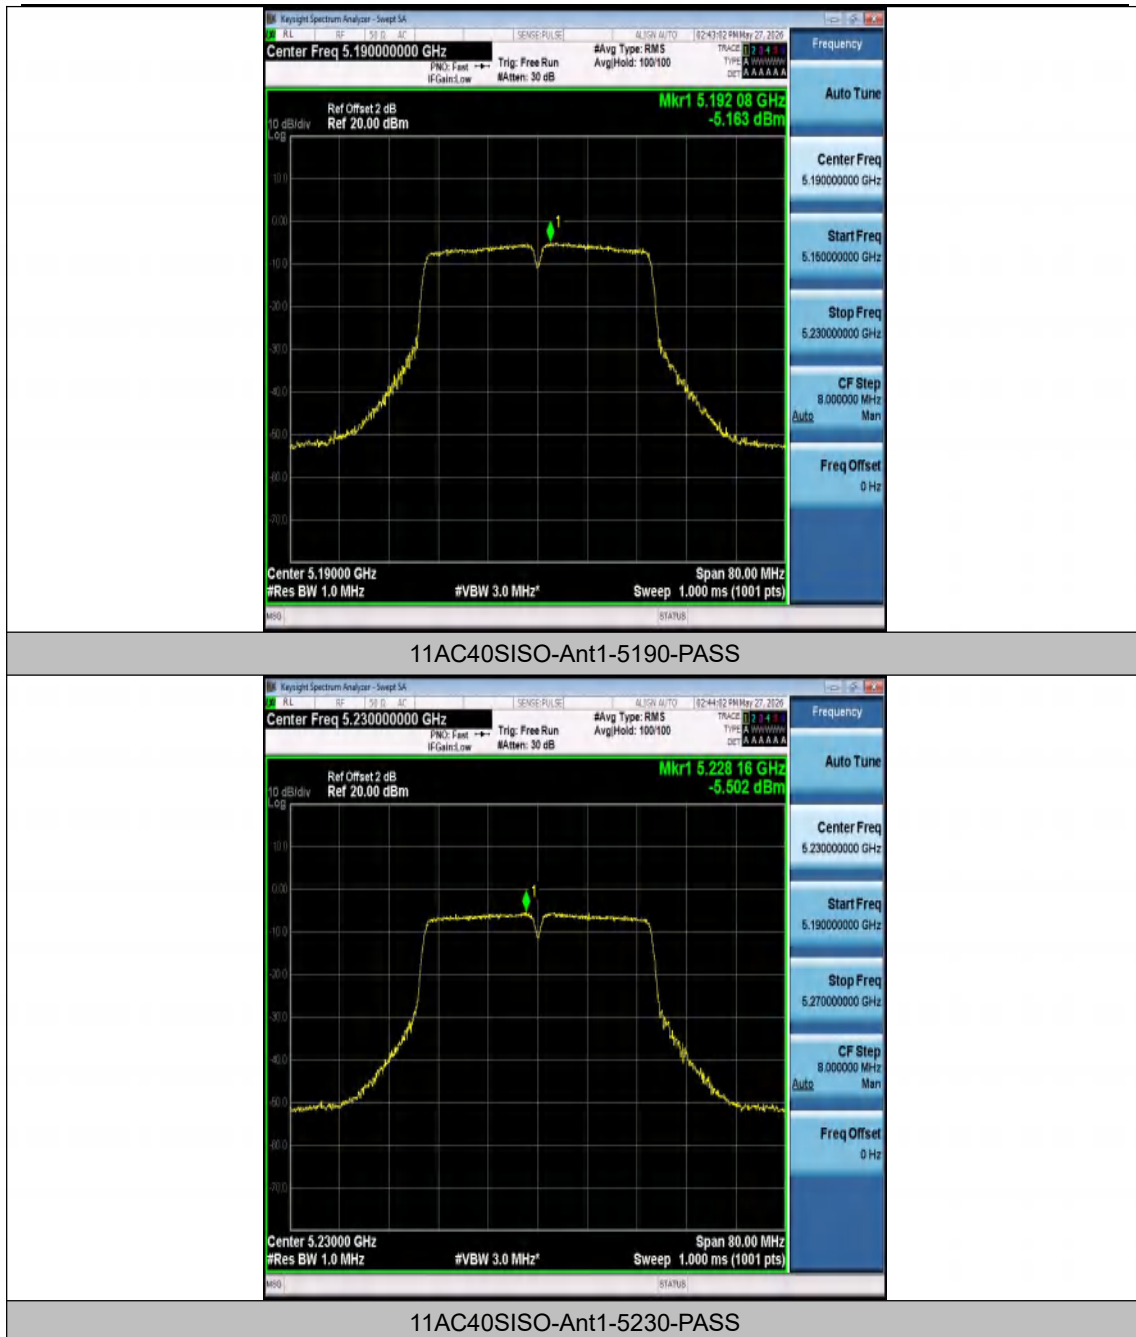

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

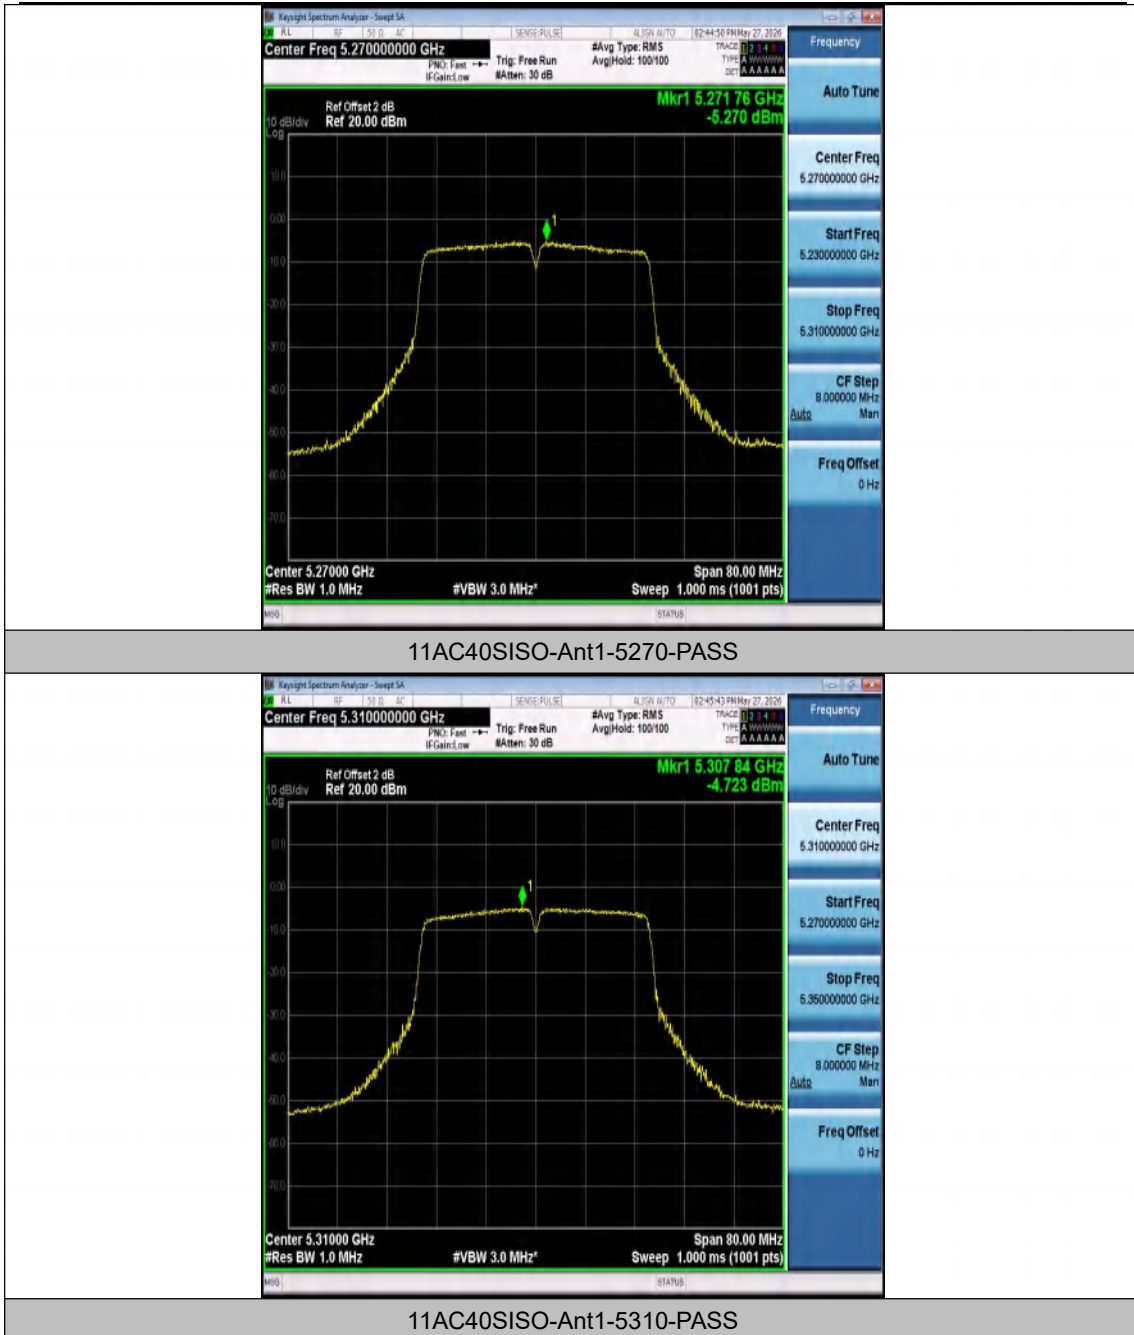

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

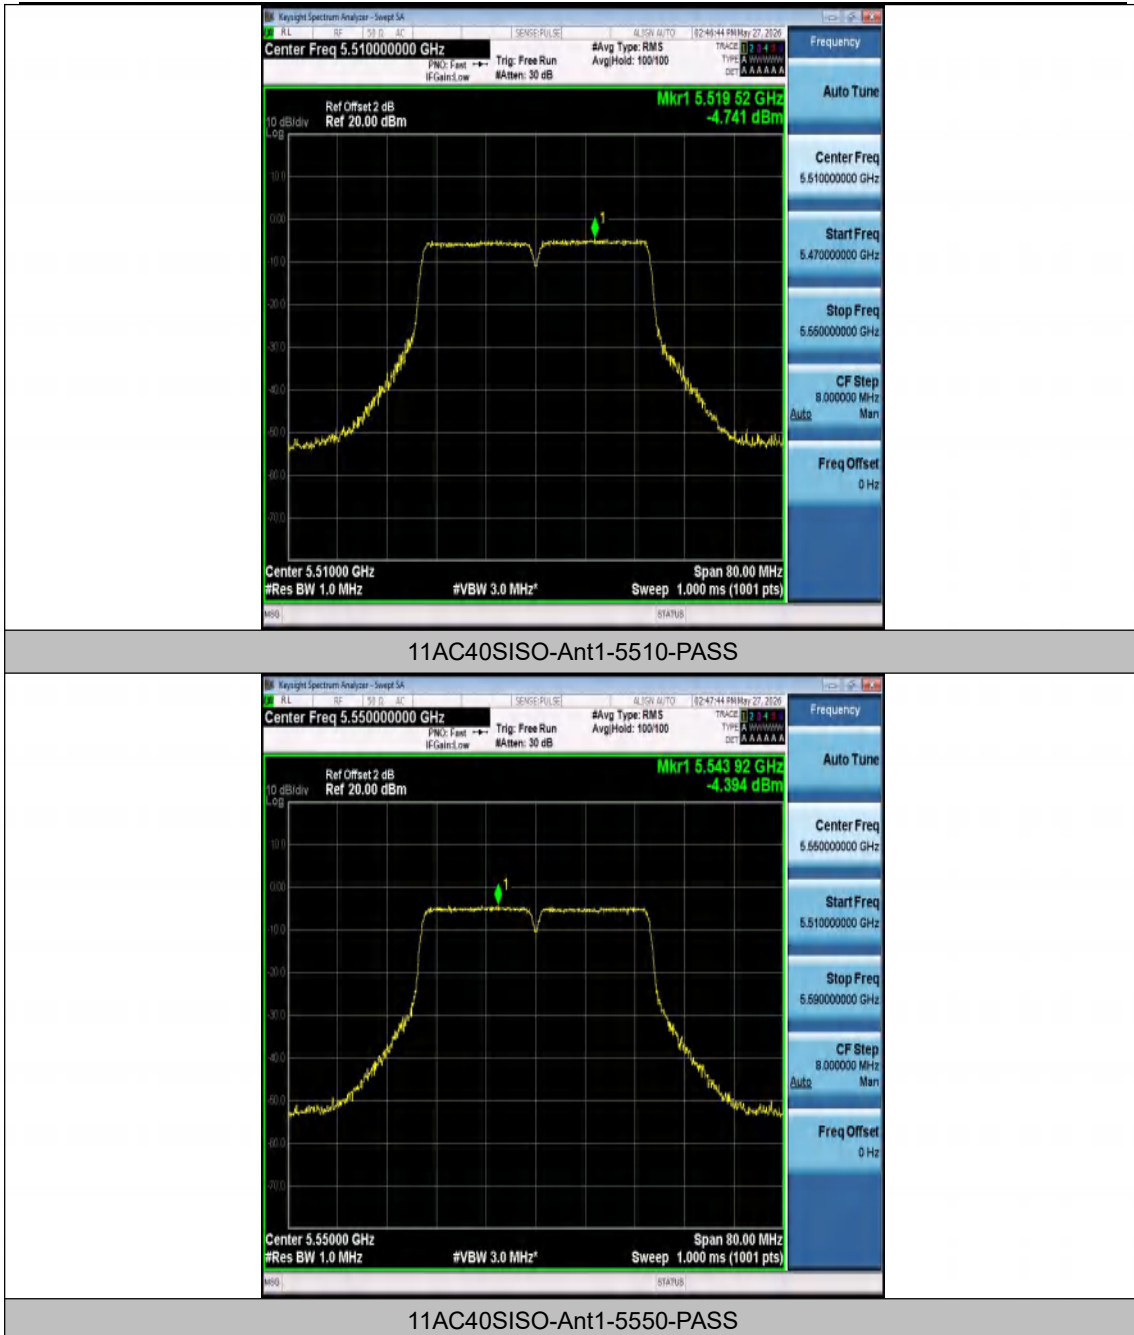

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

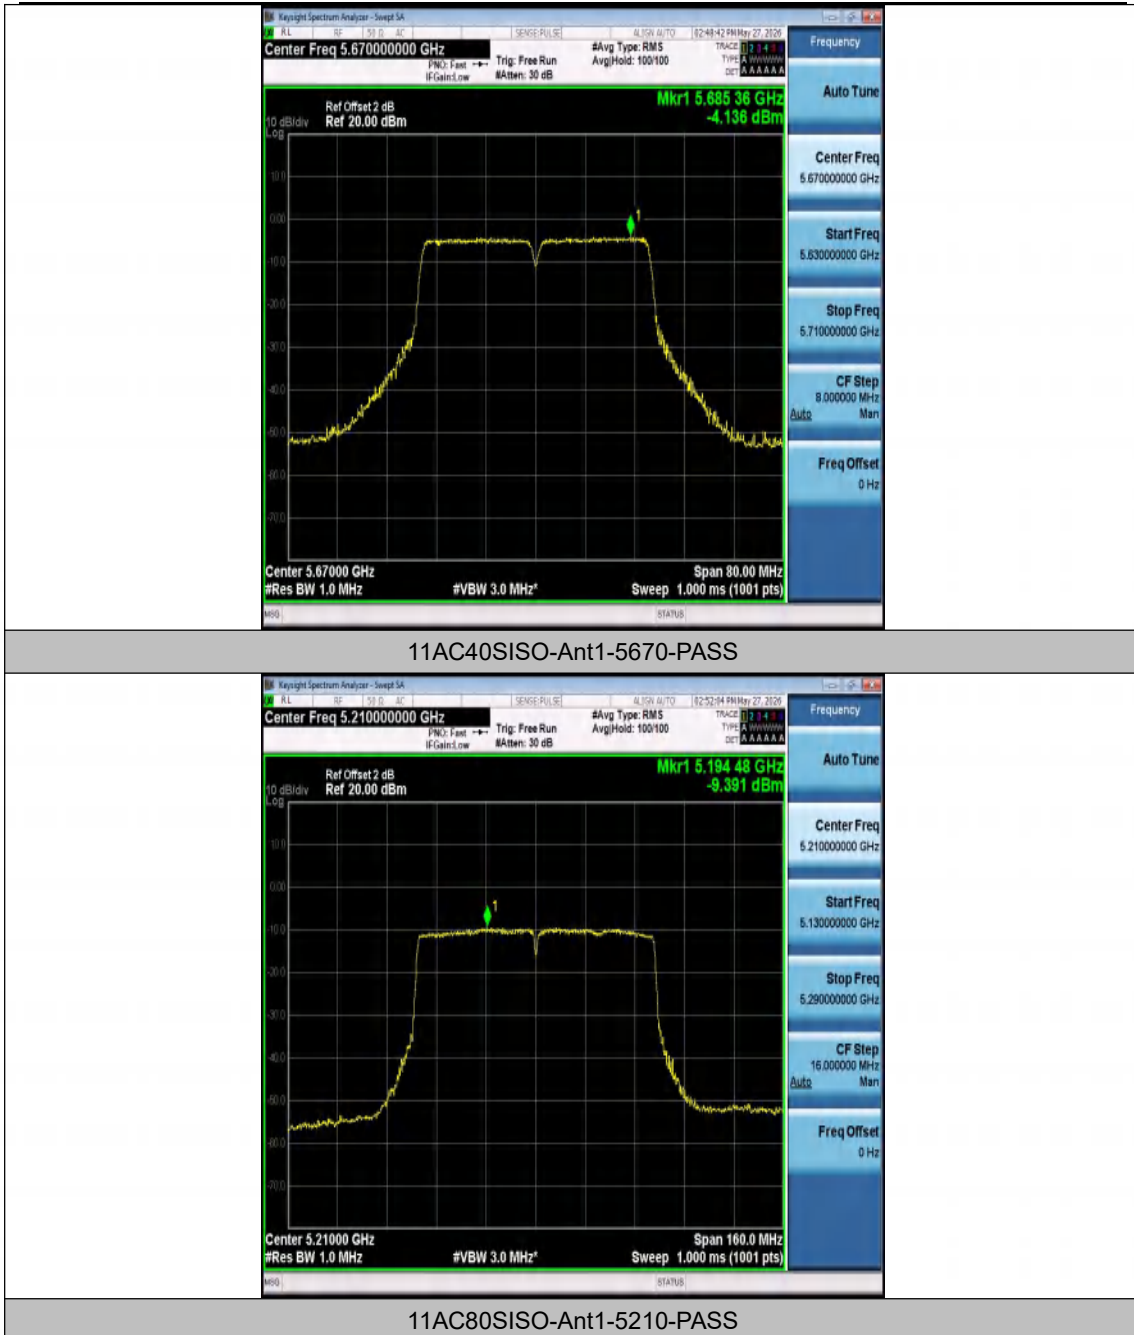

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

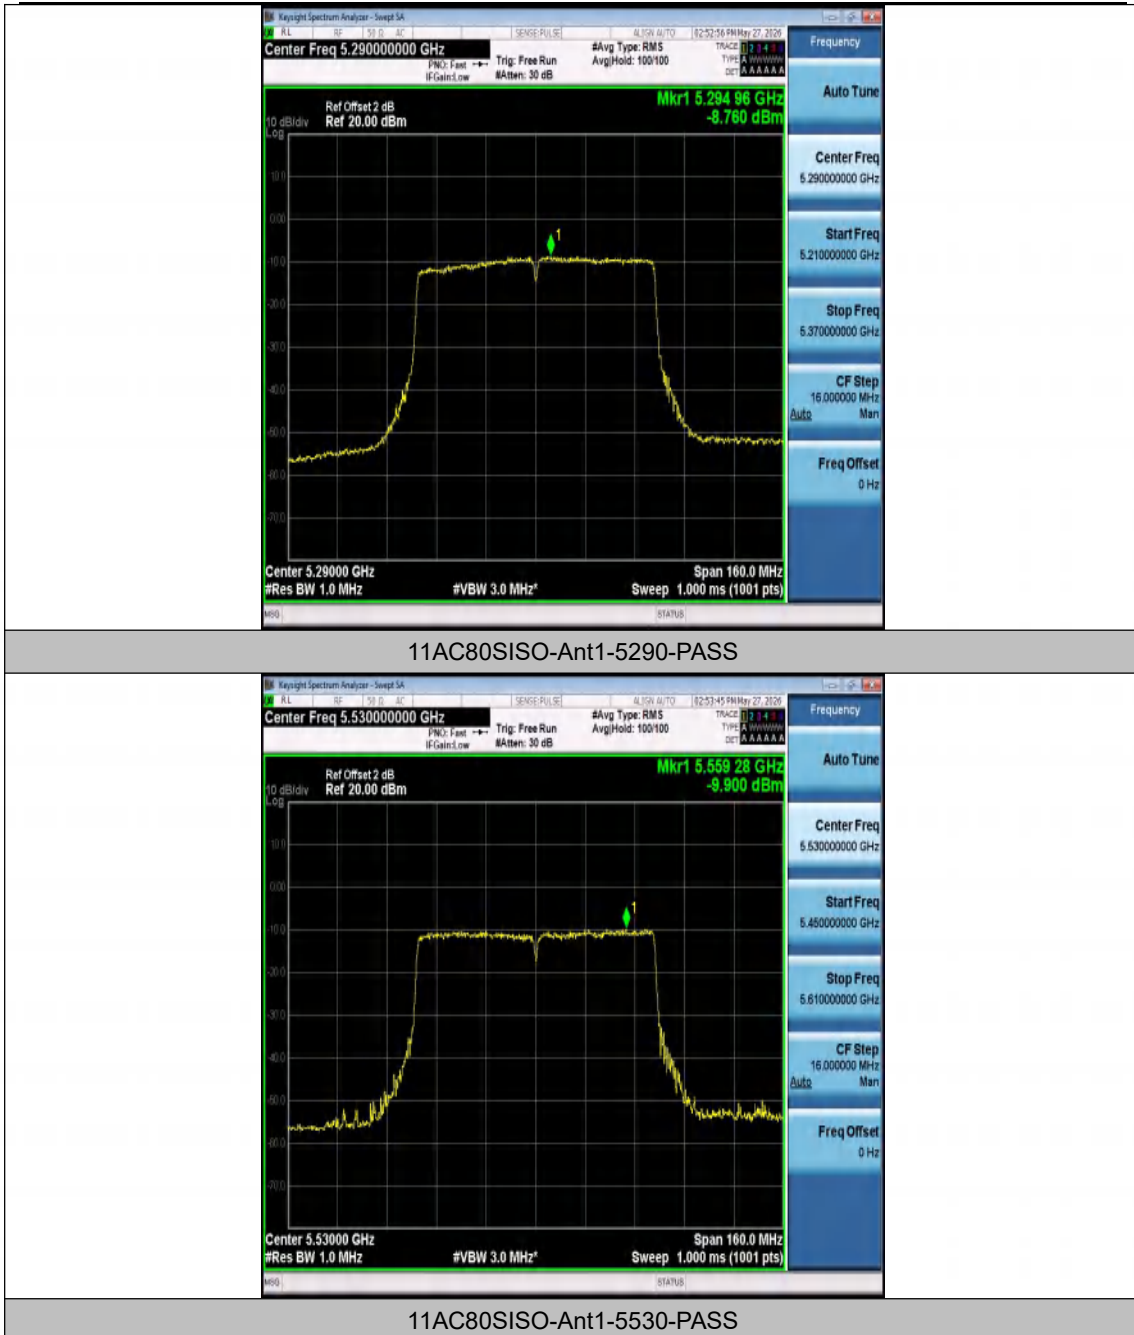

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

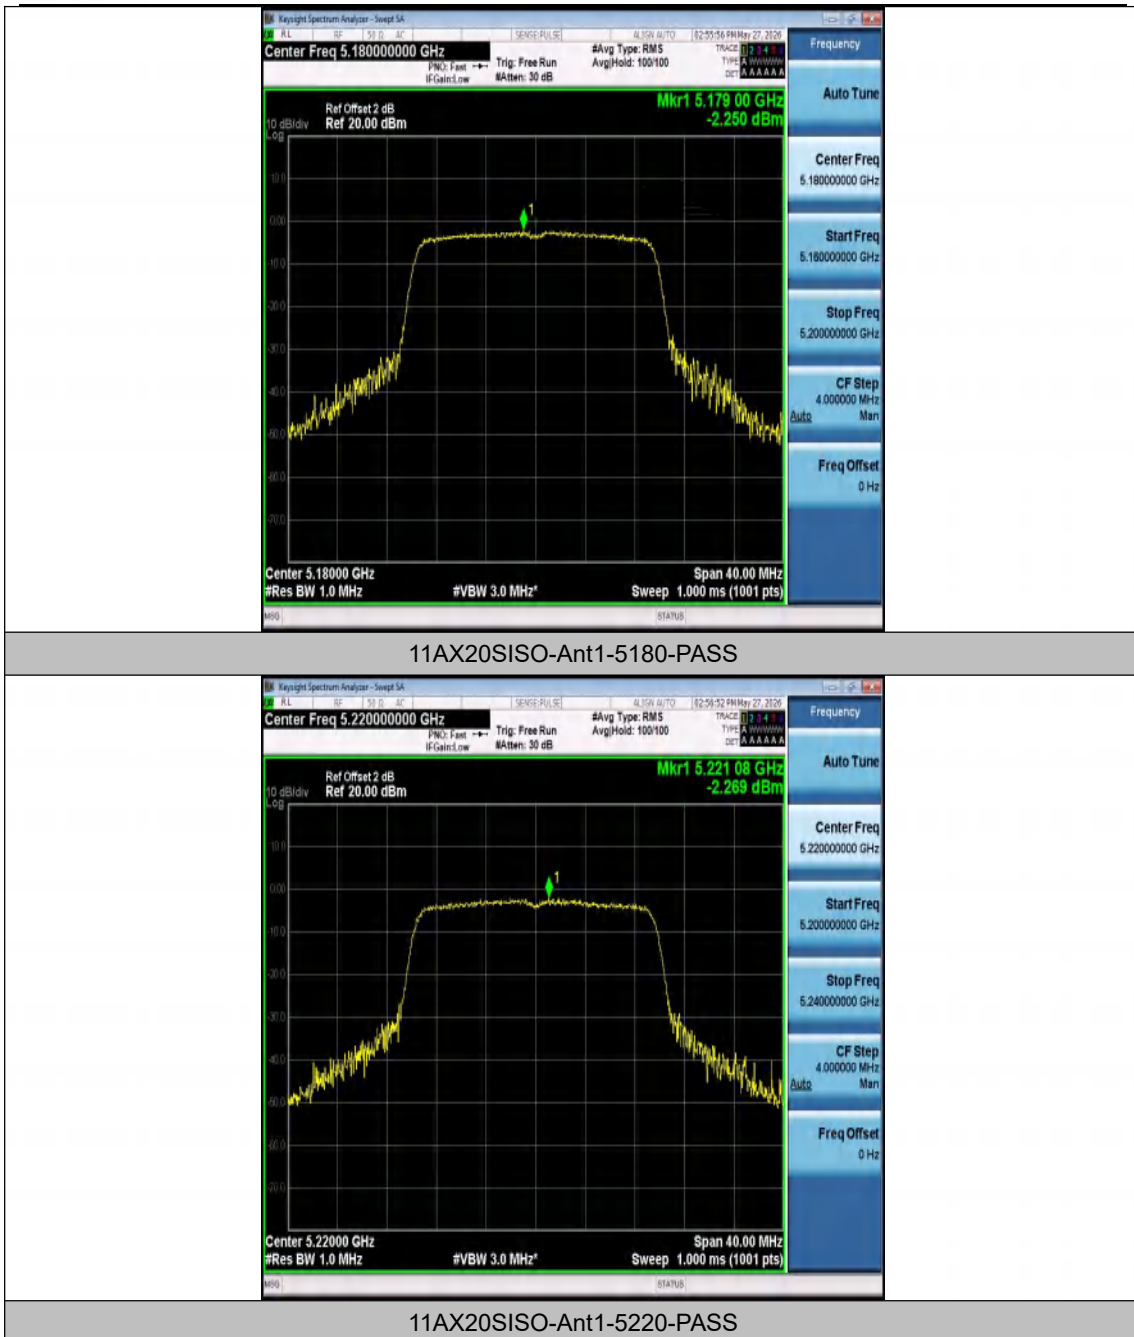

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

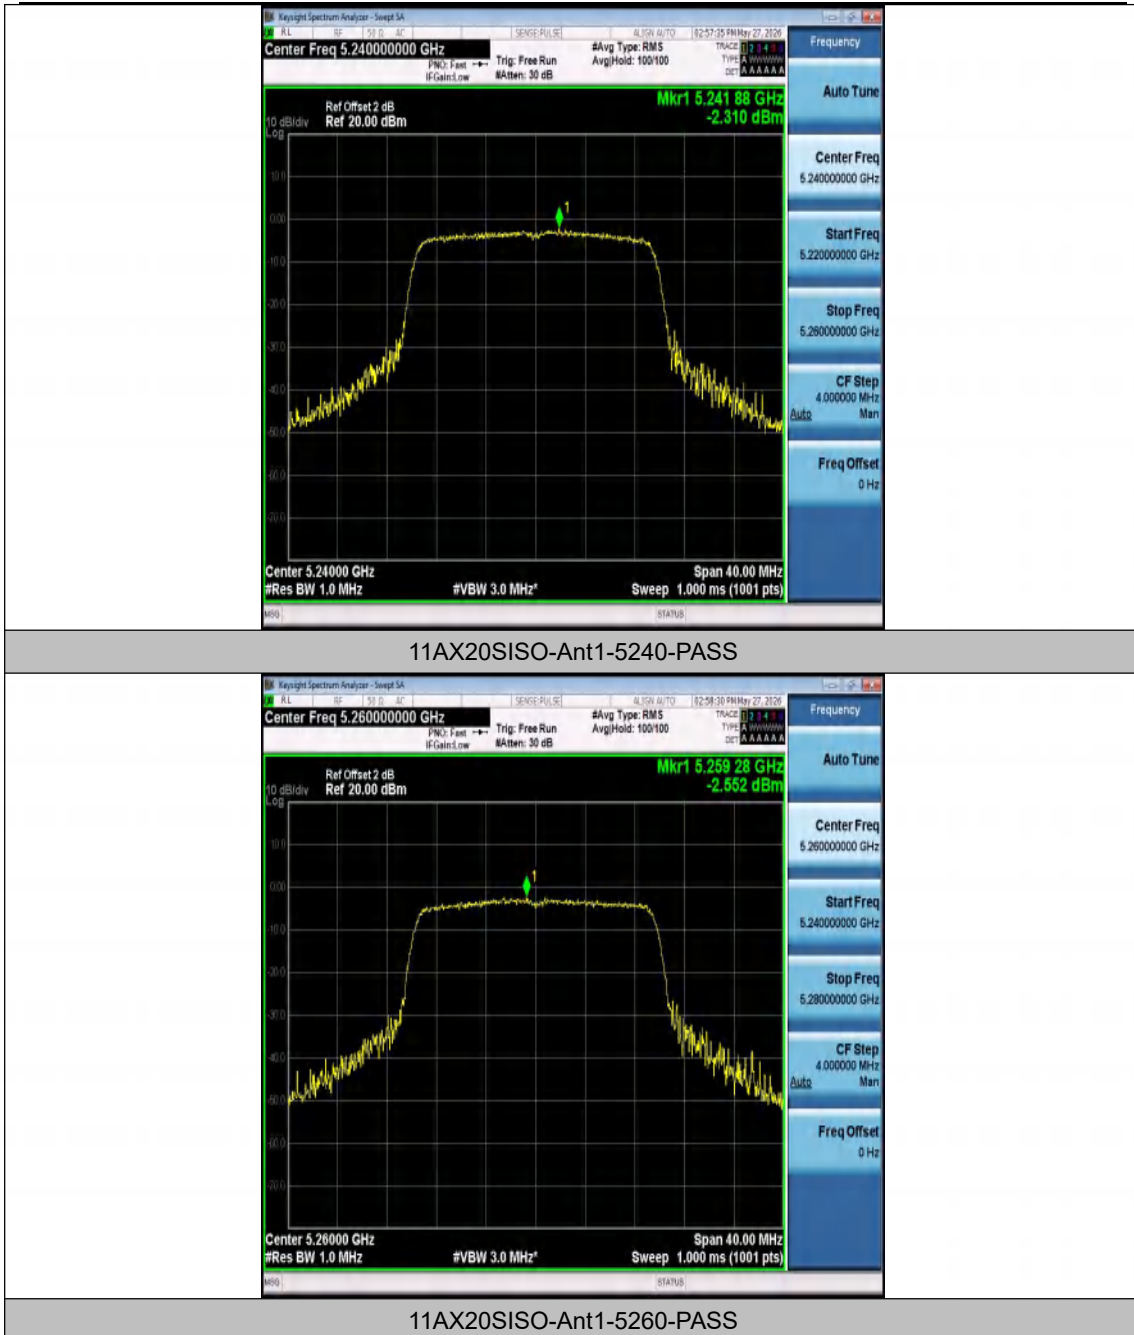

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

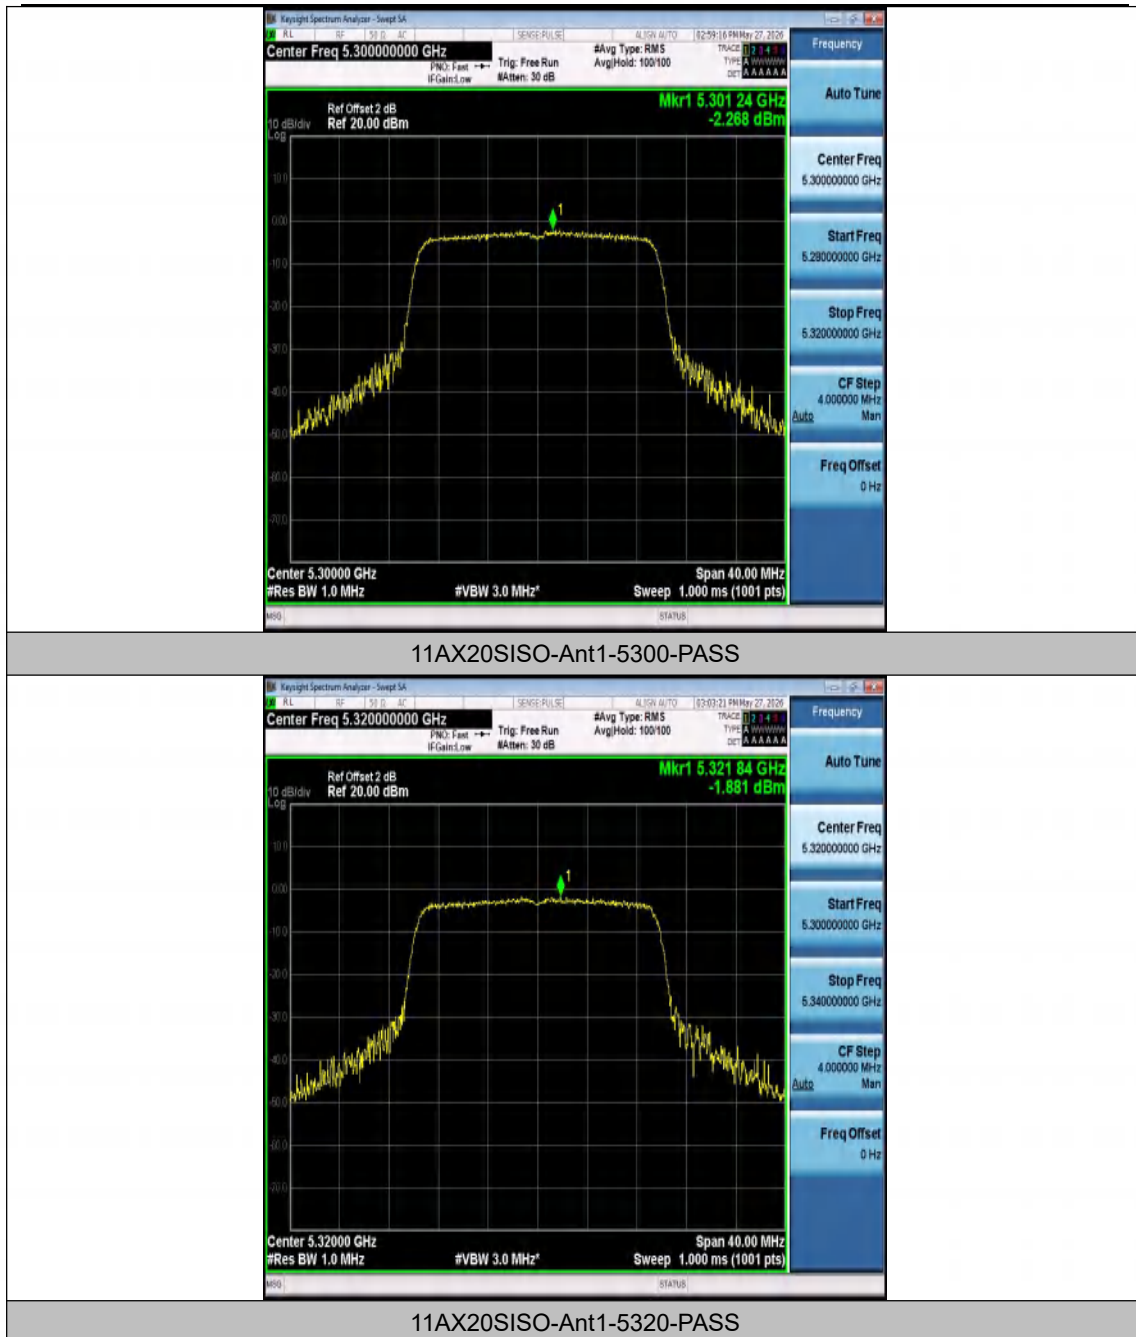

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

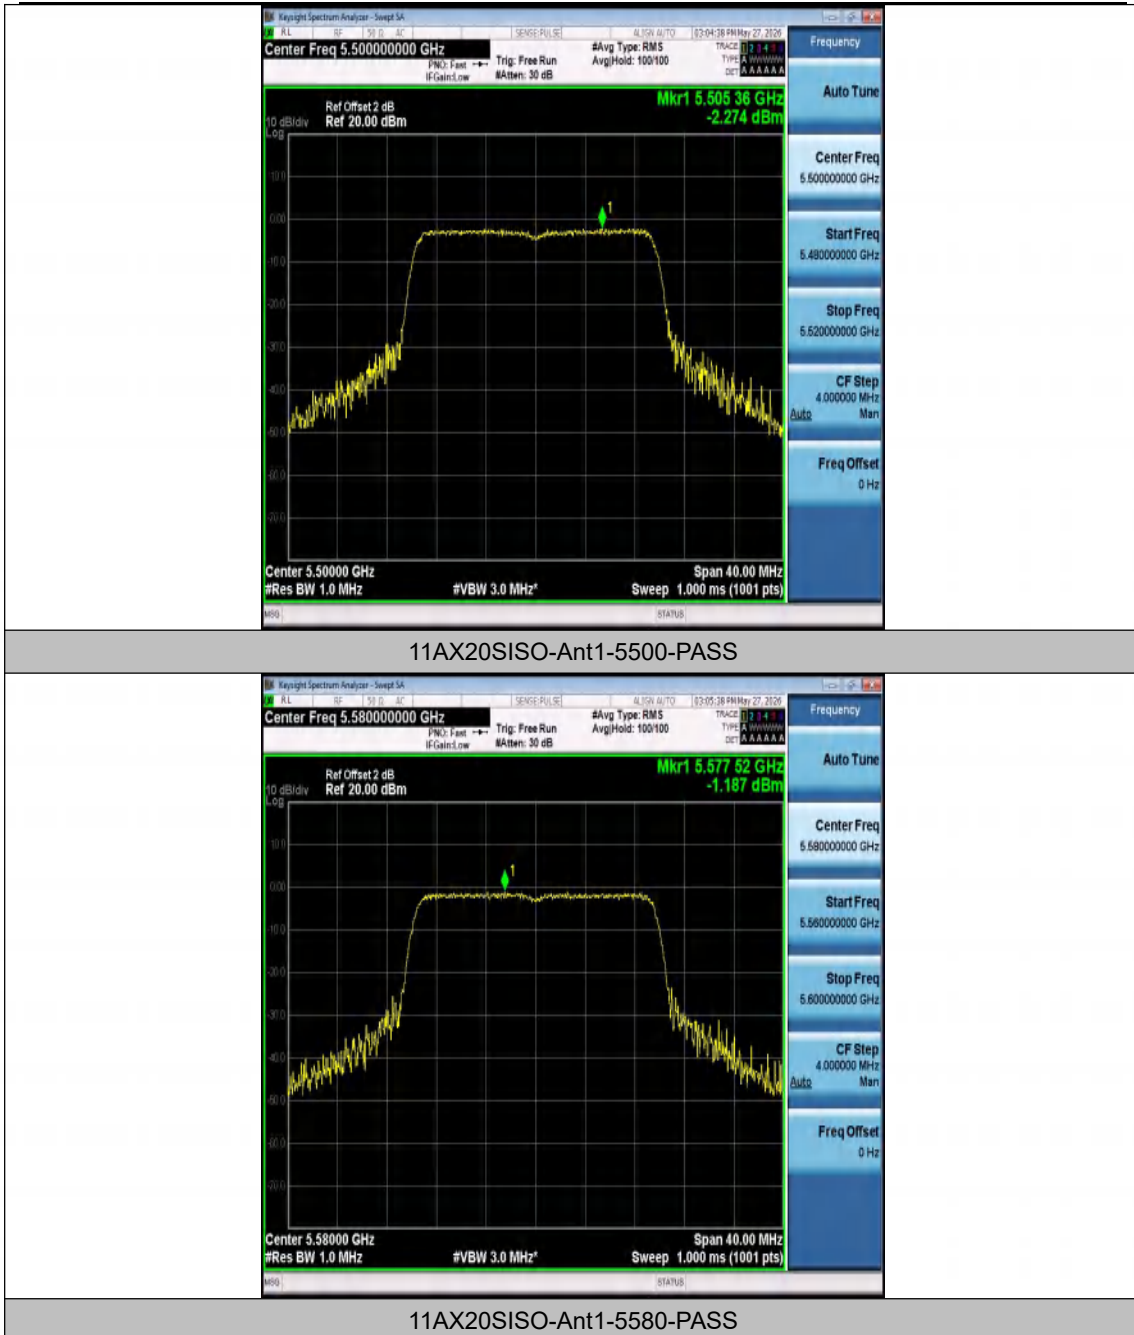

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

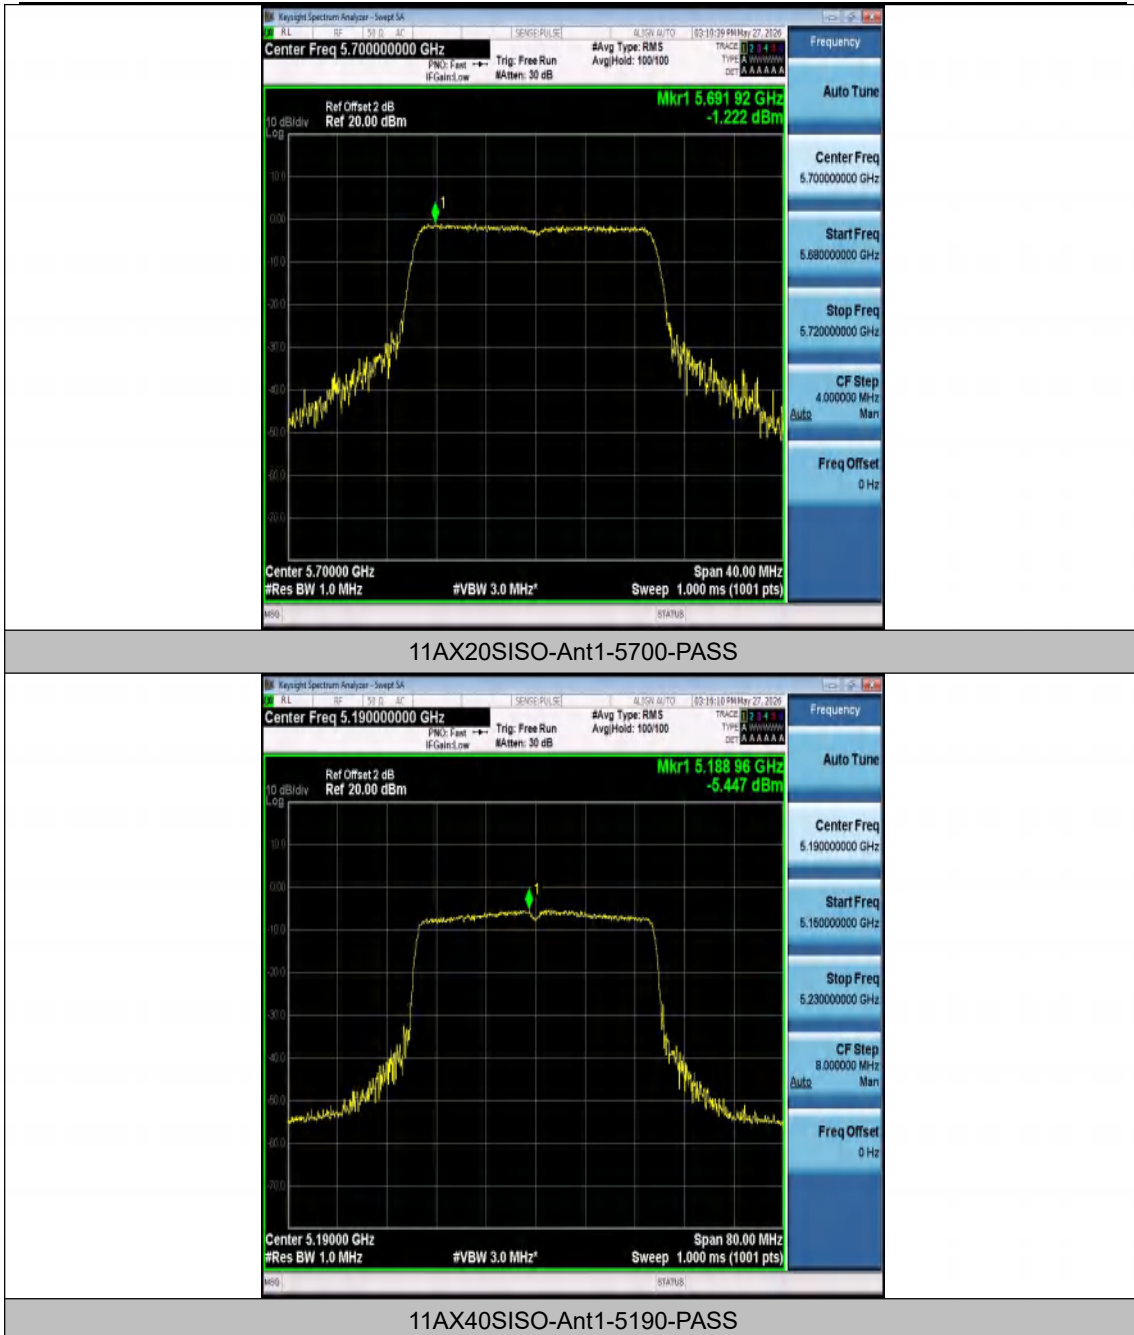

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

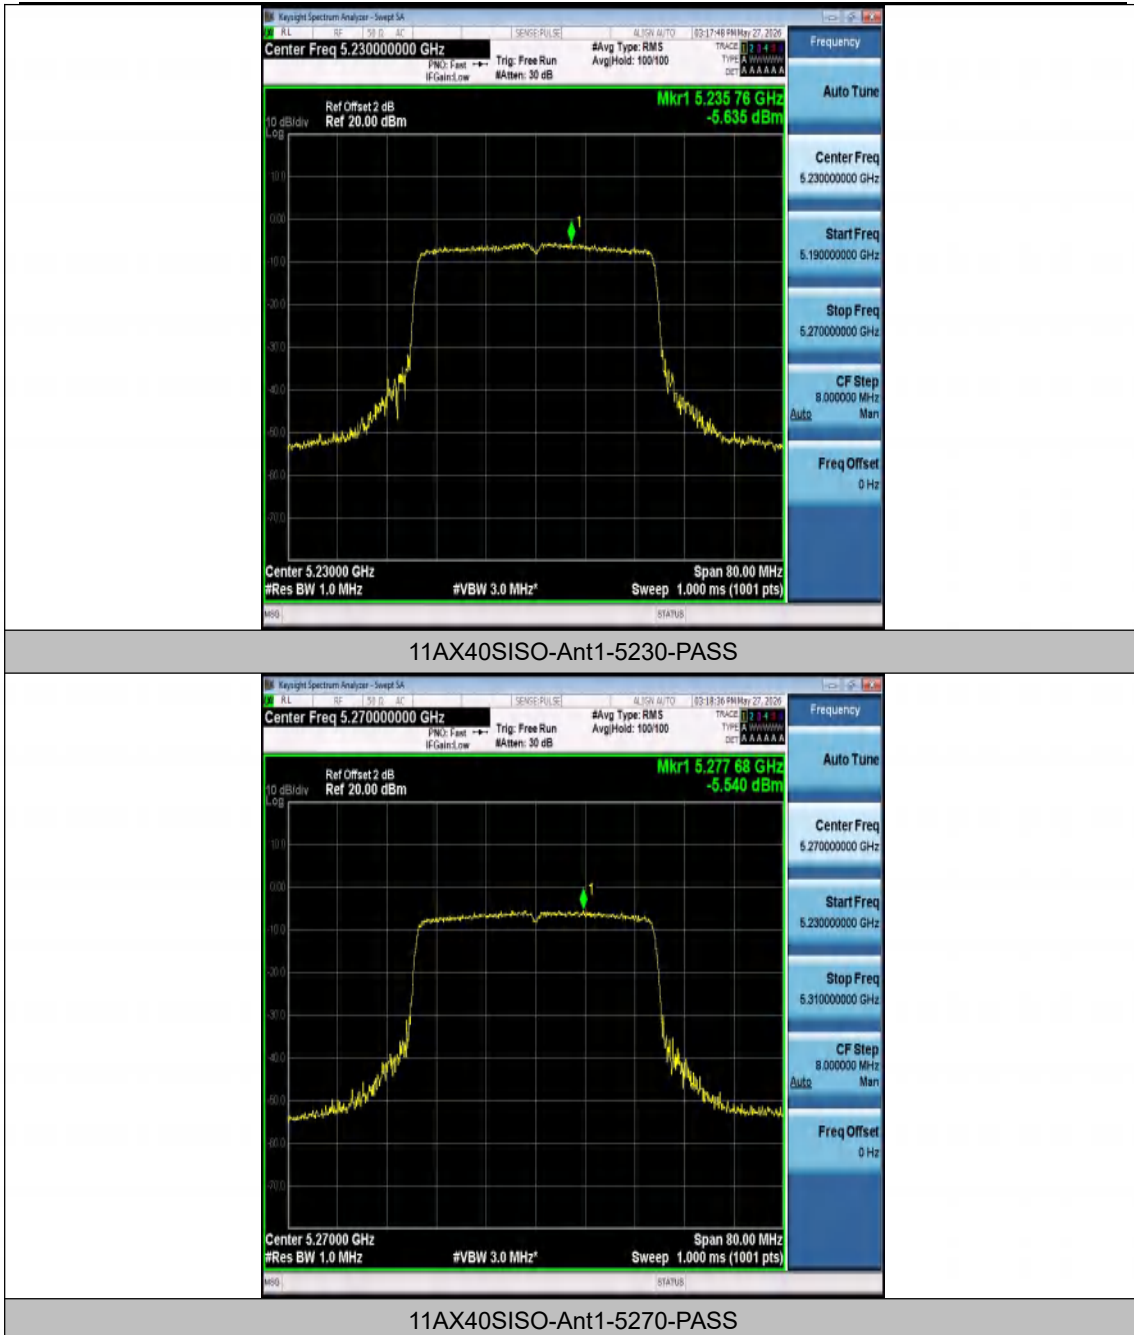

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

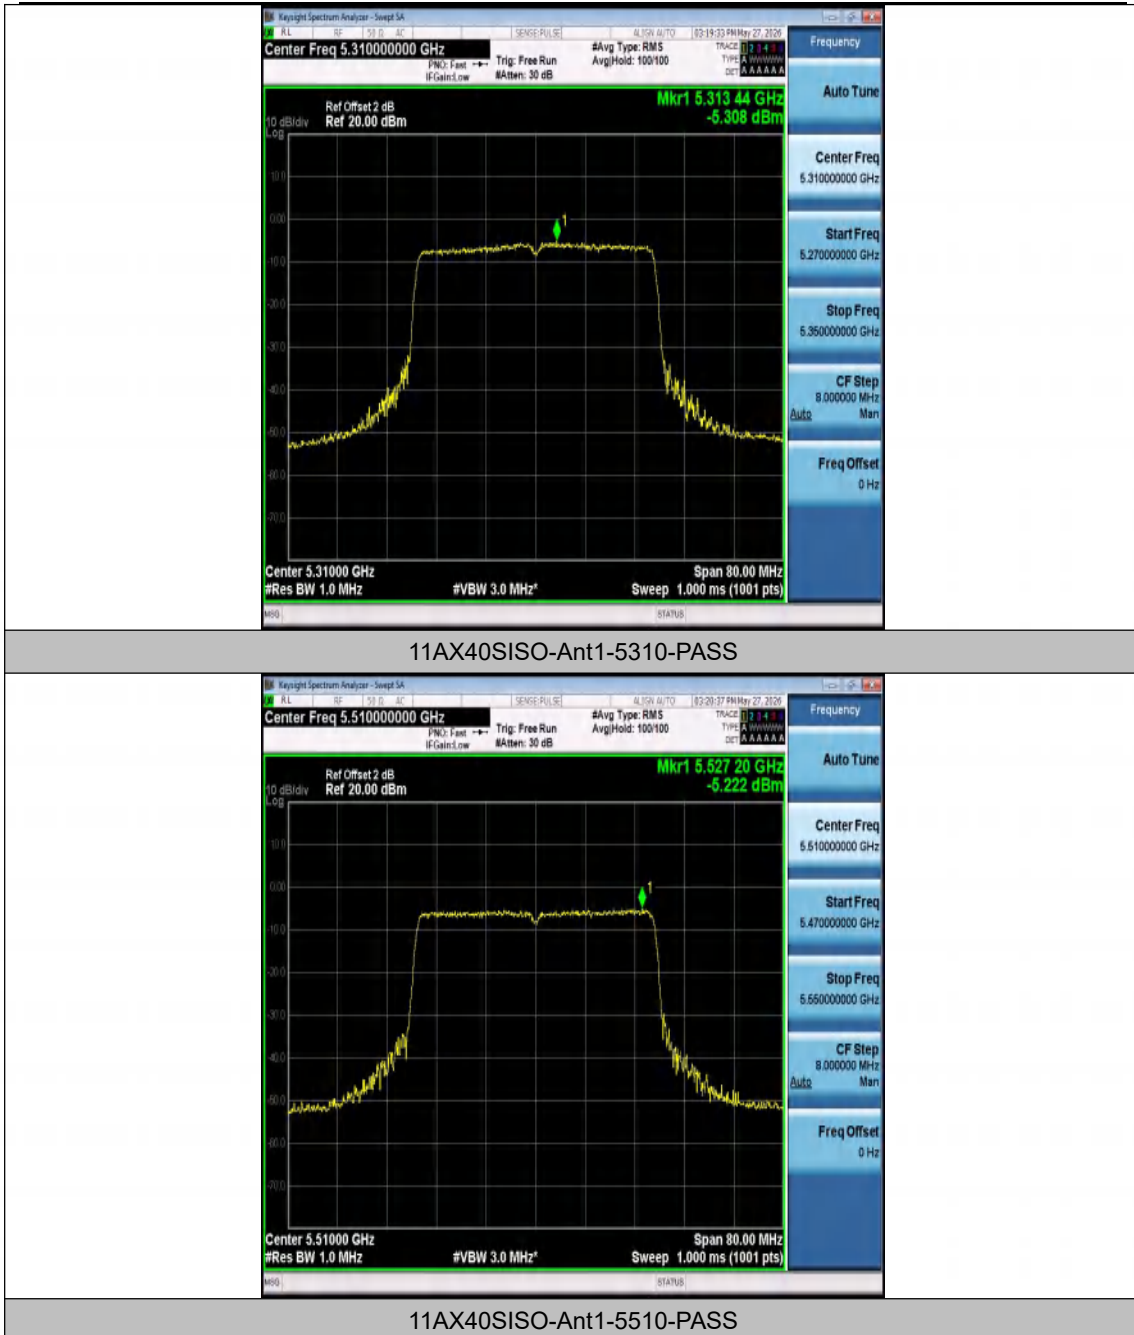

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

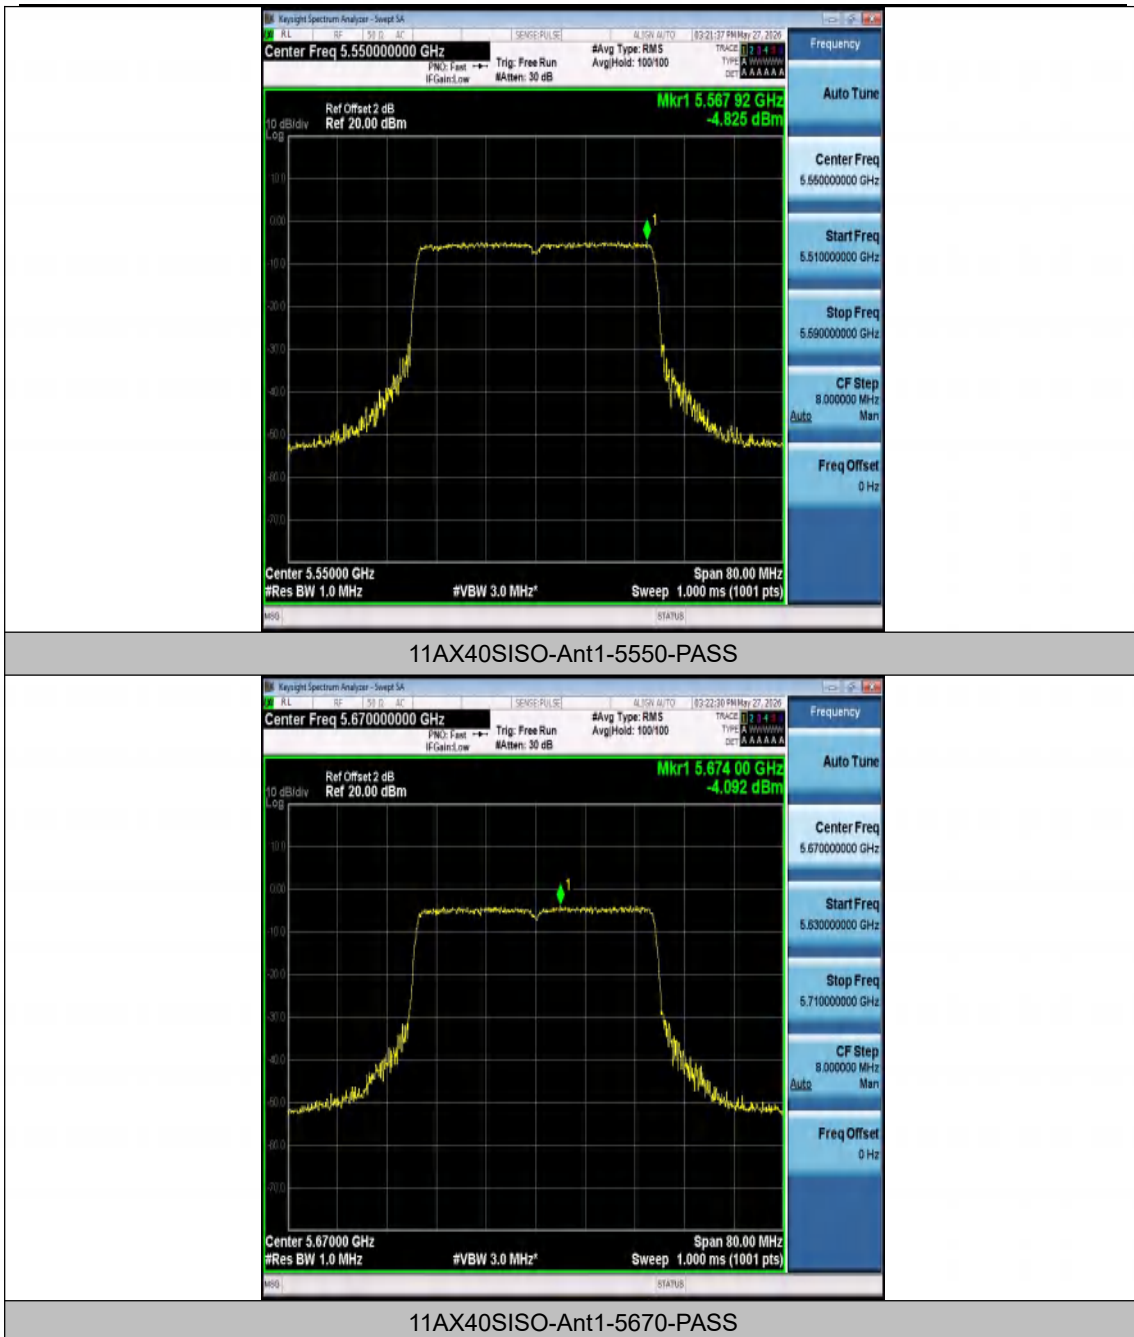

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

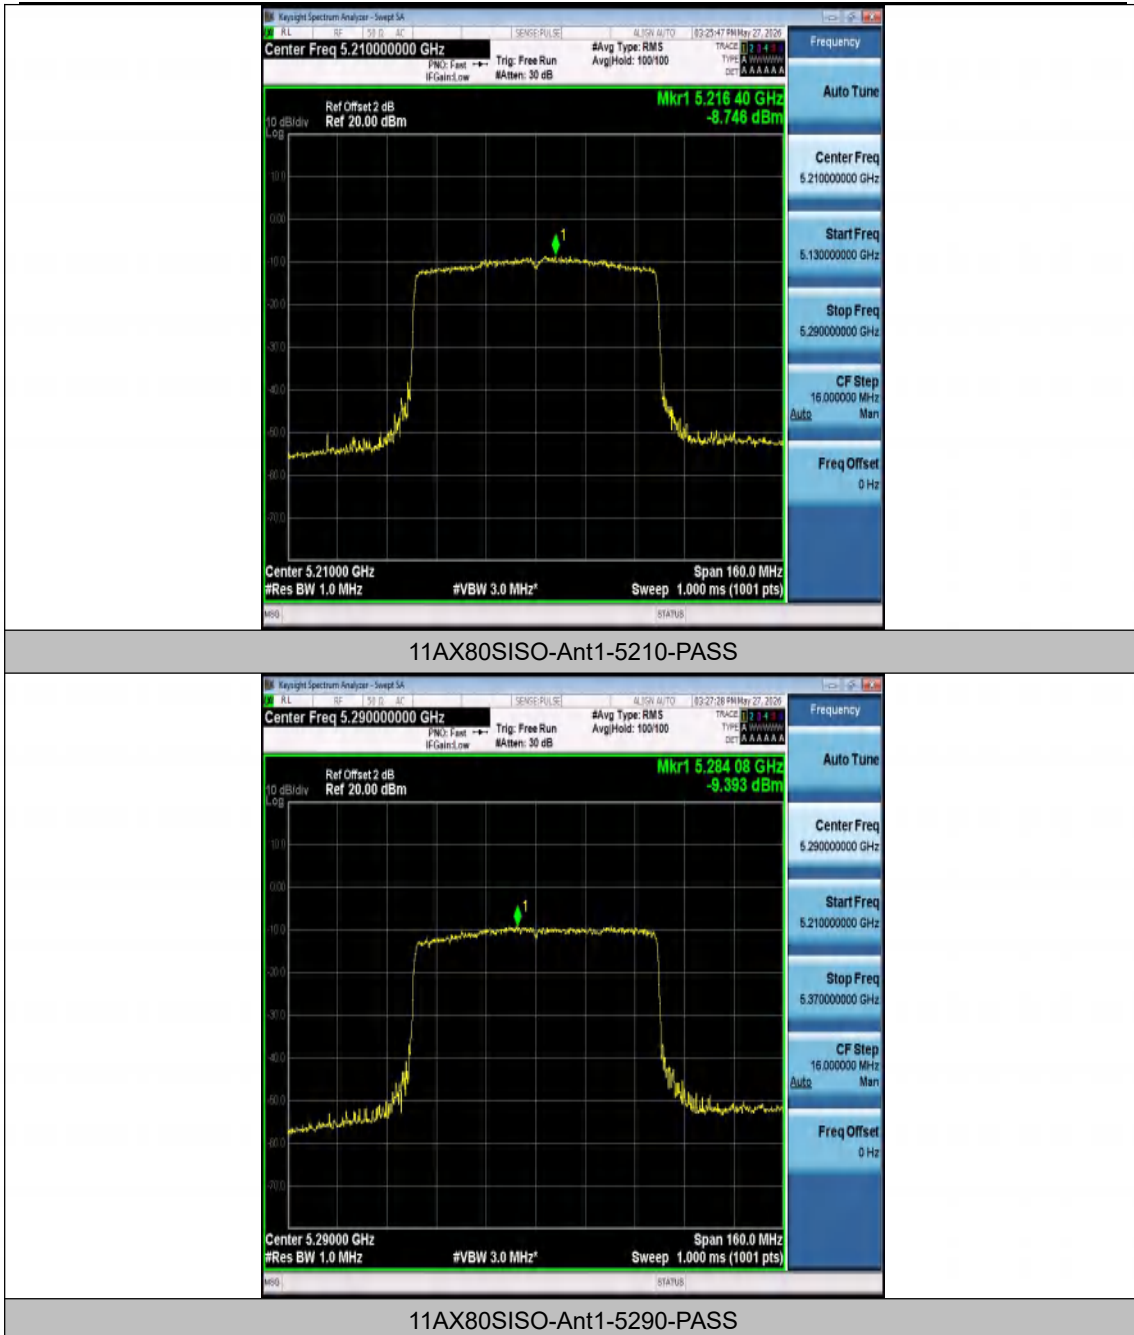

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

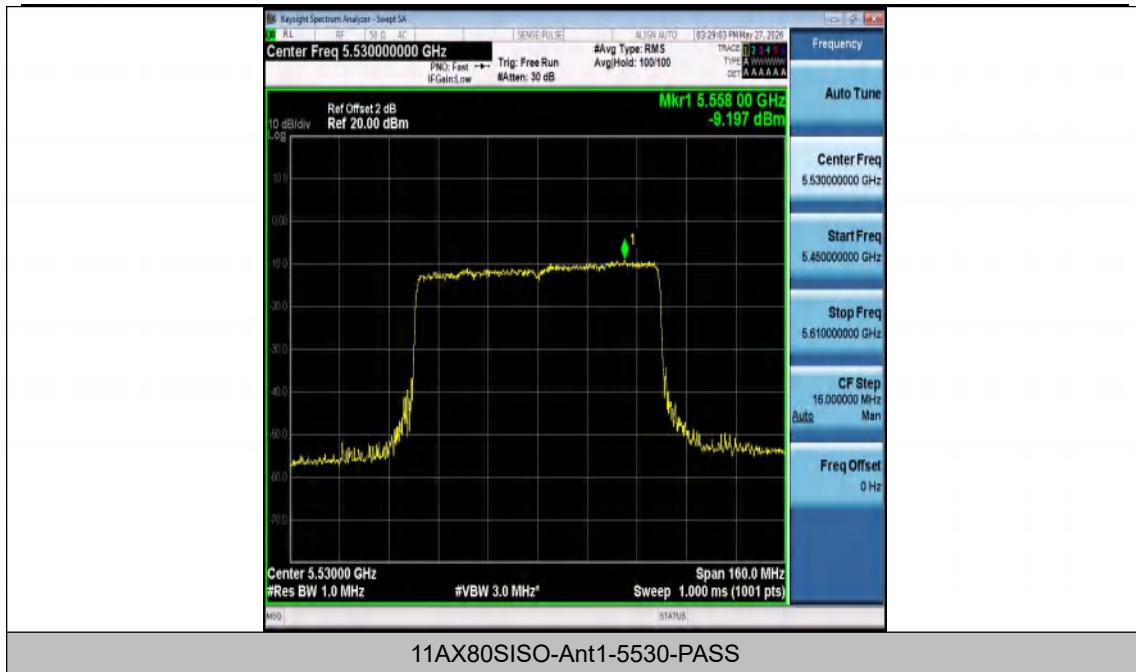


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Test GraphsB4

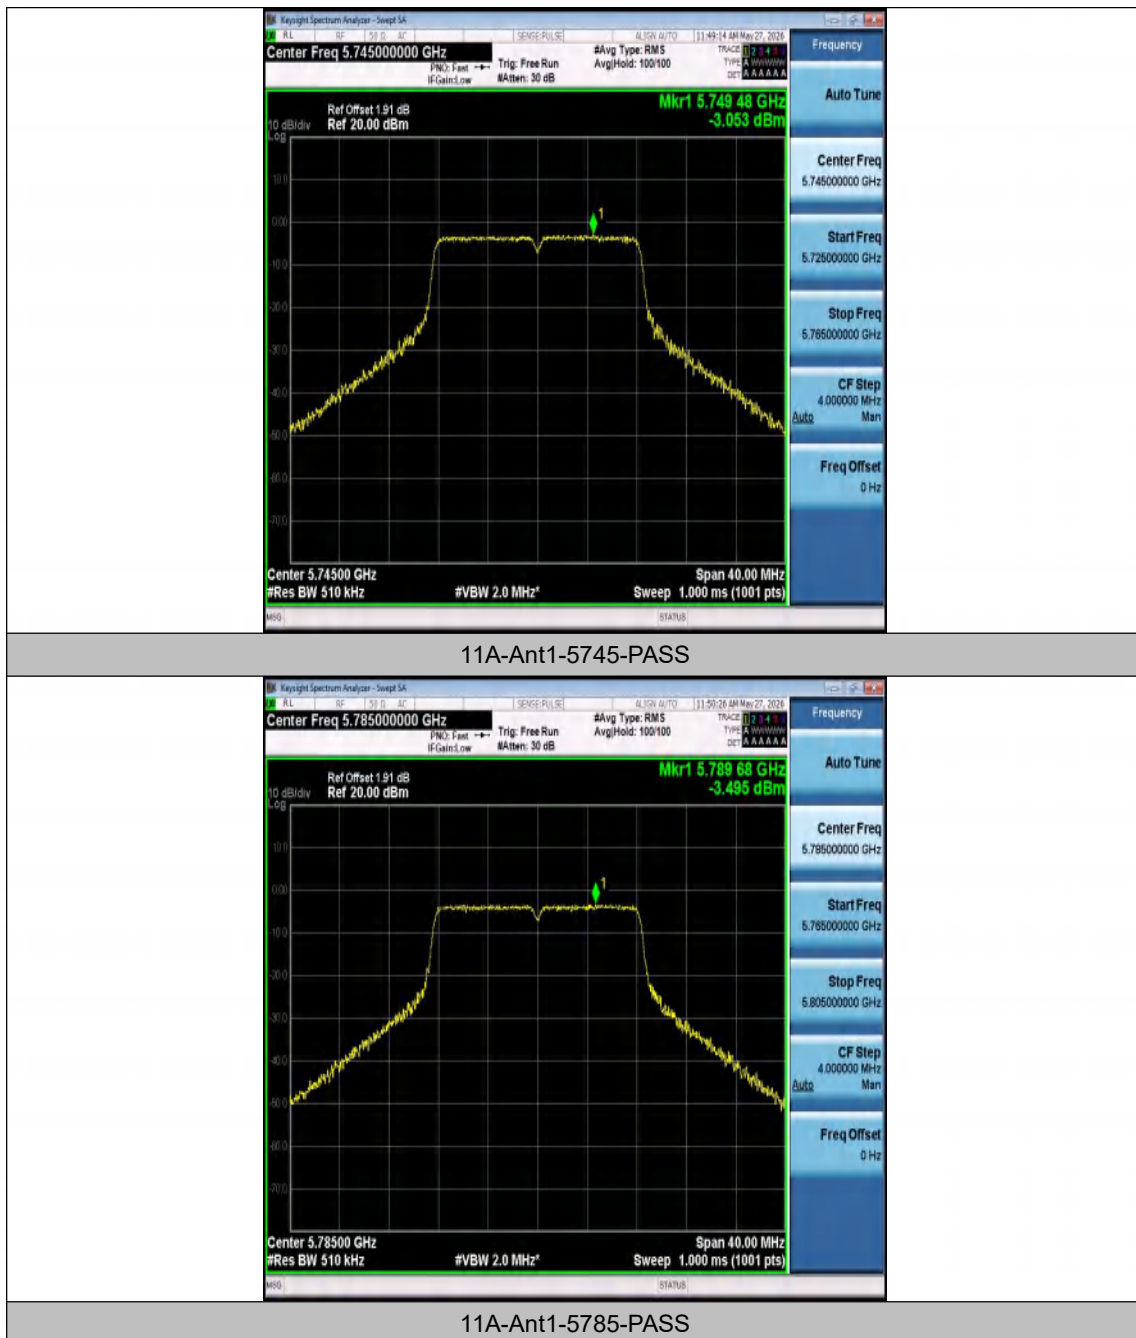

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

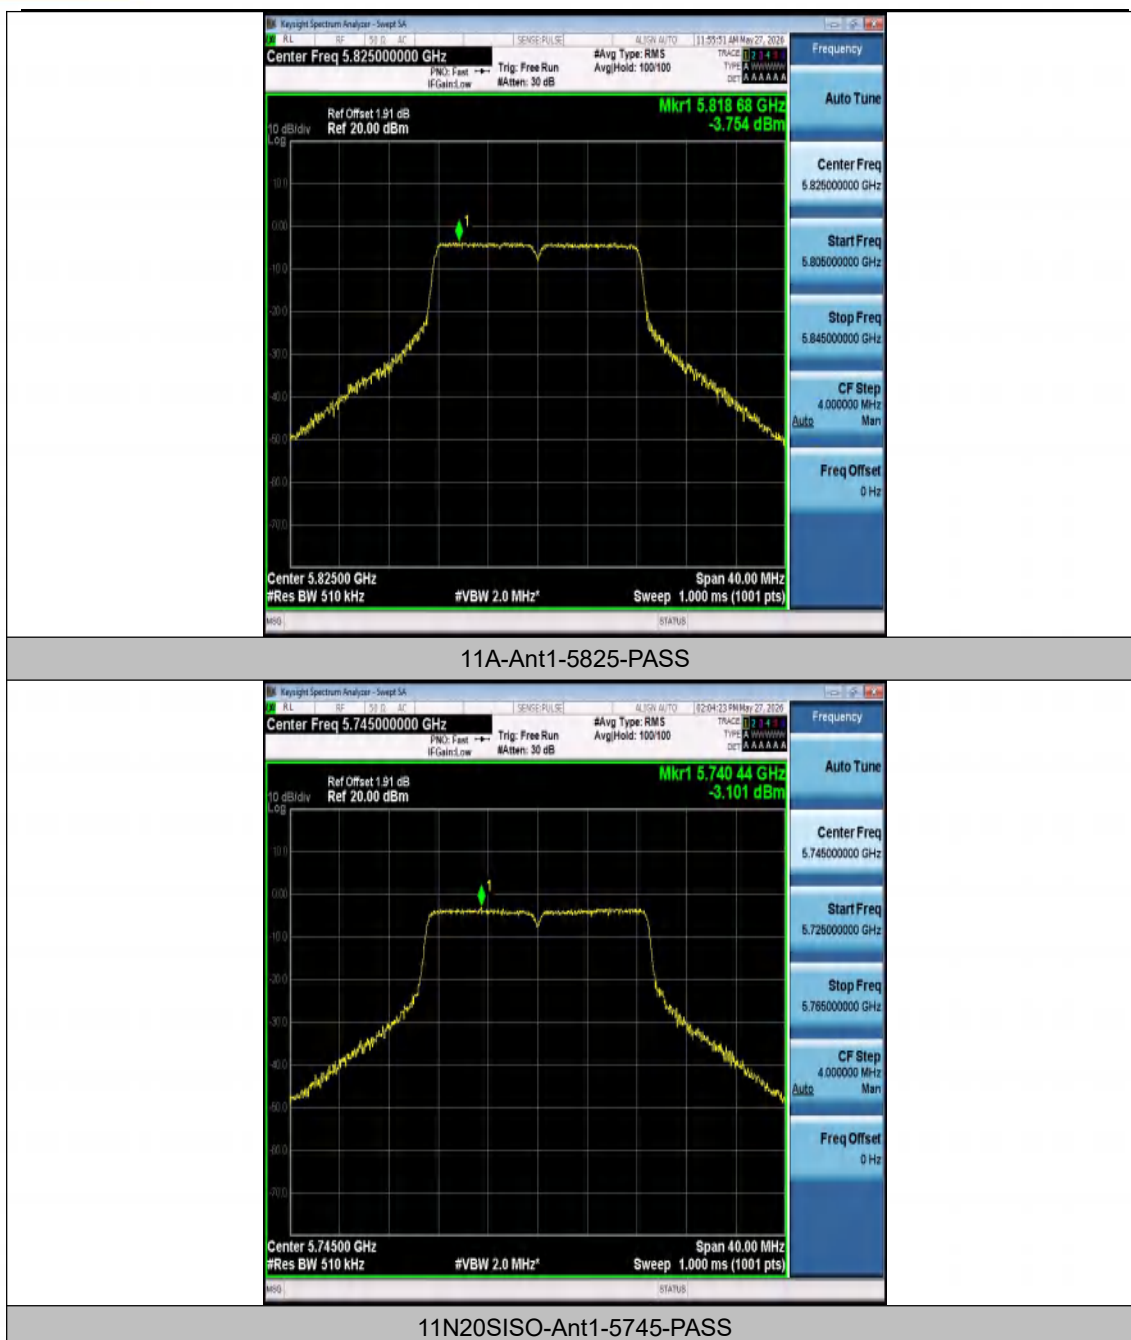

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

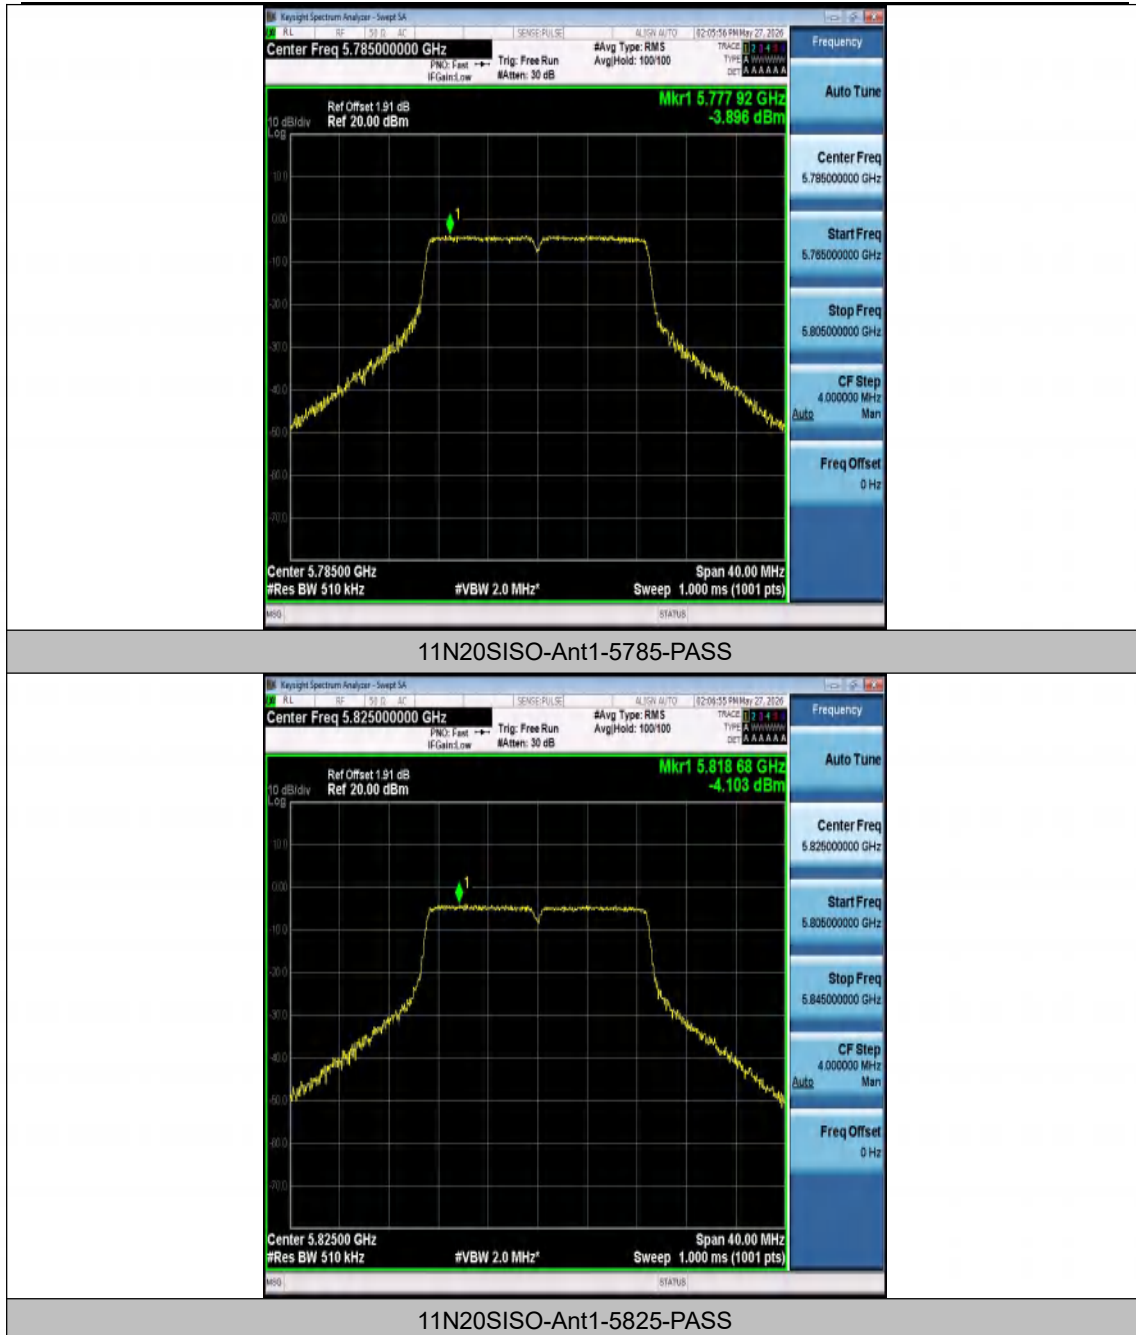

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

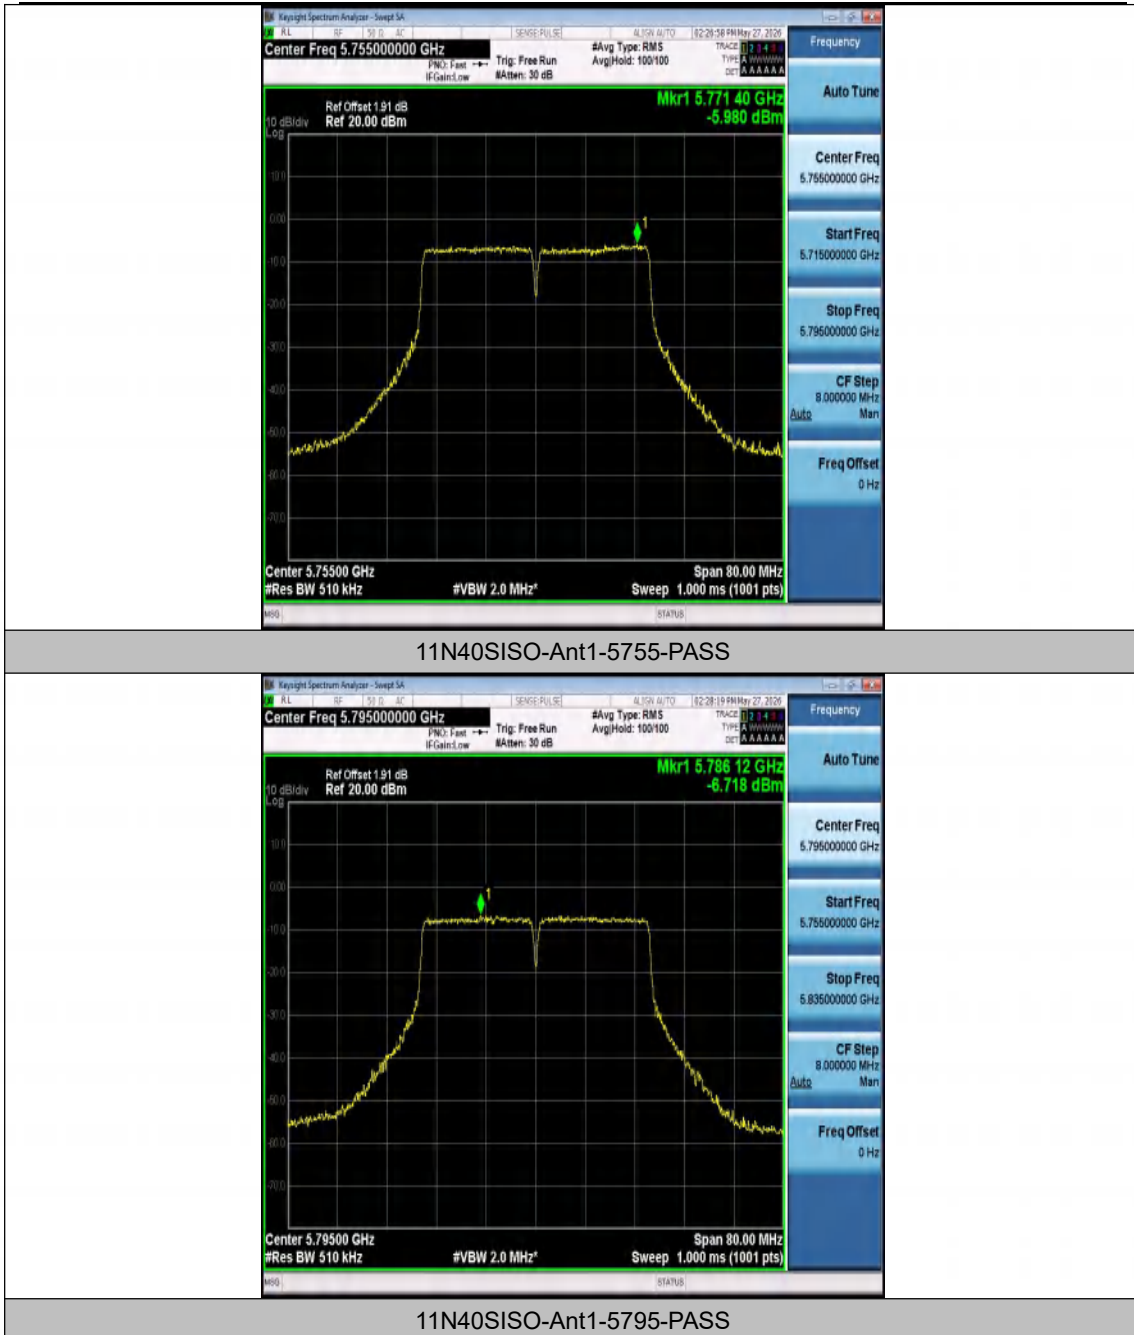


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

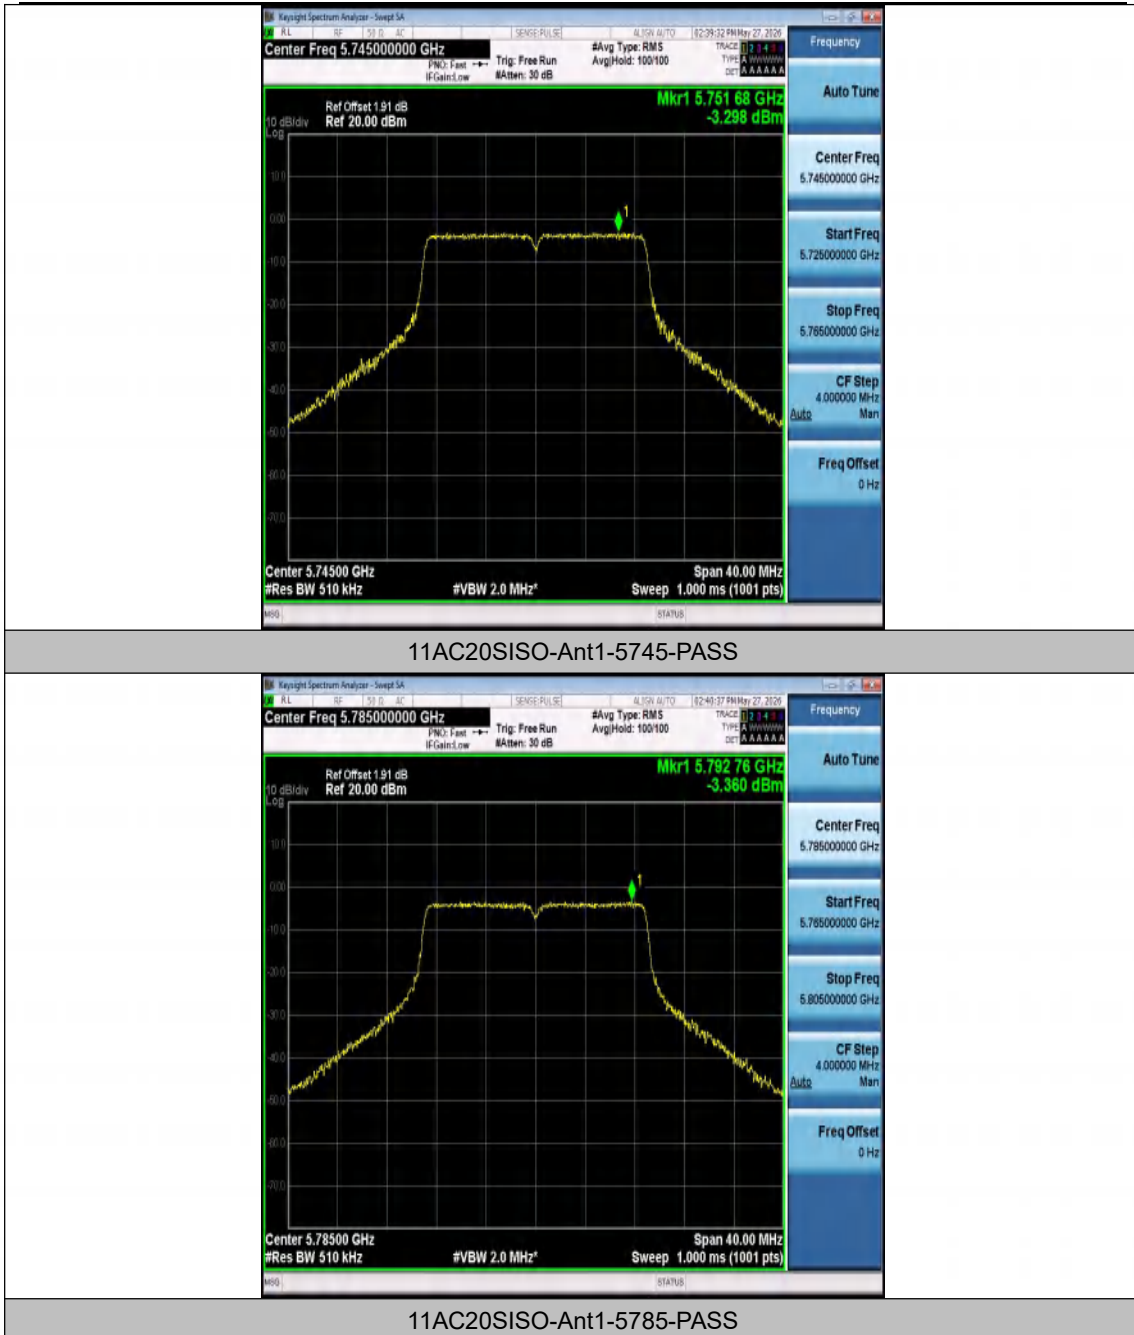


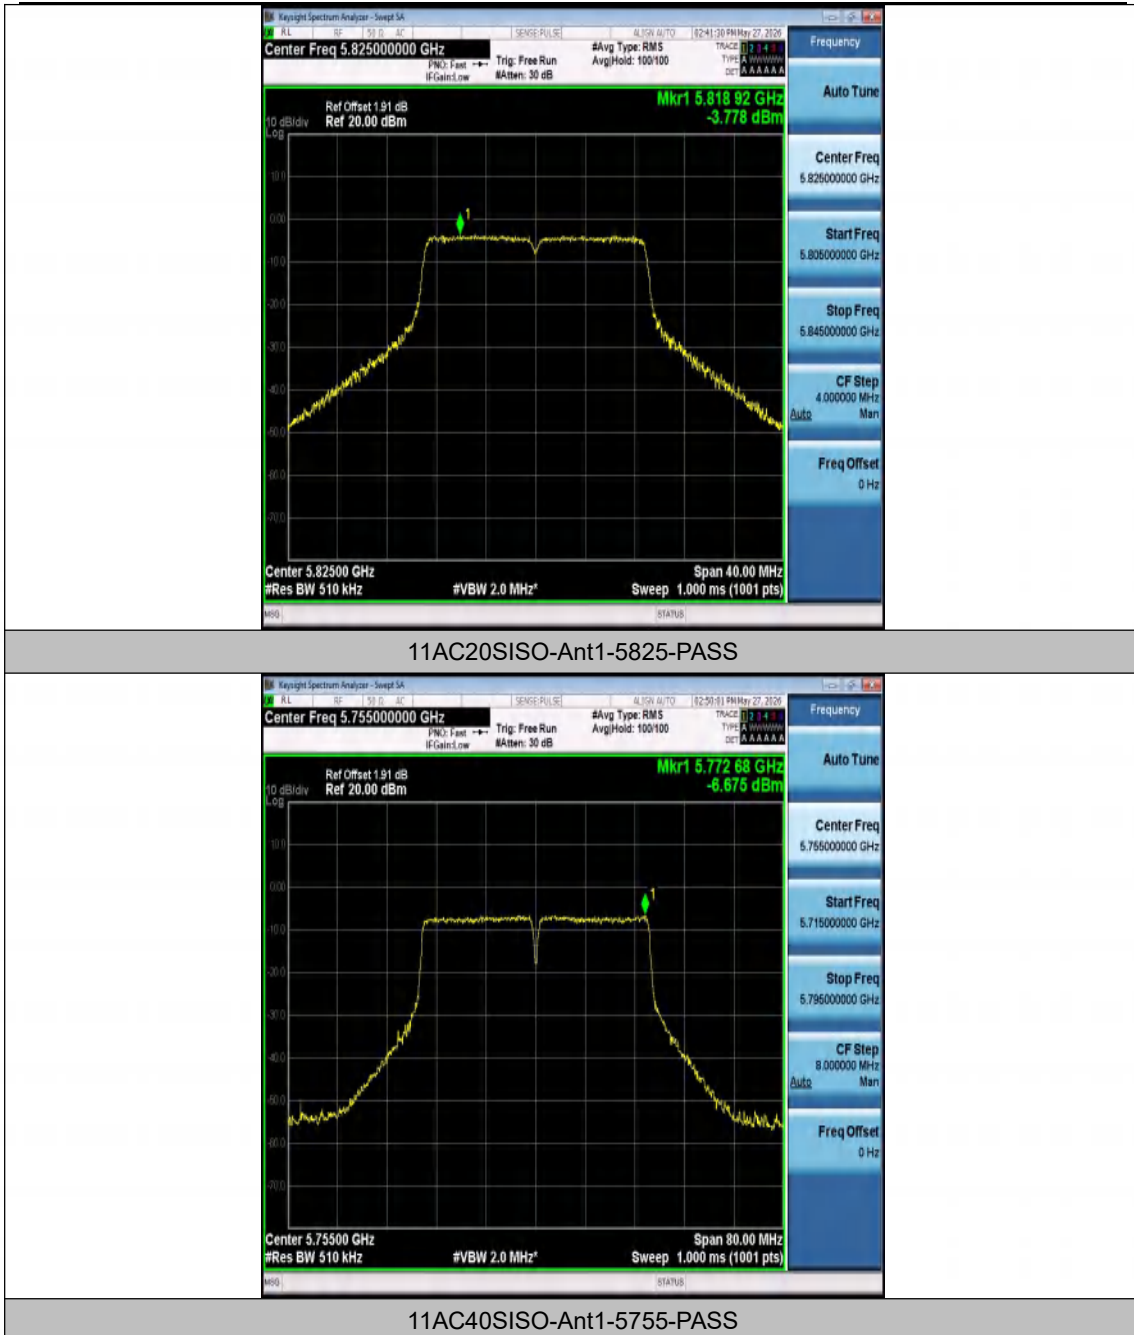

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

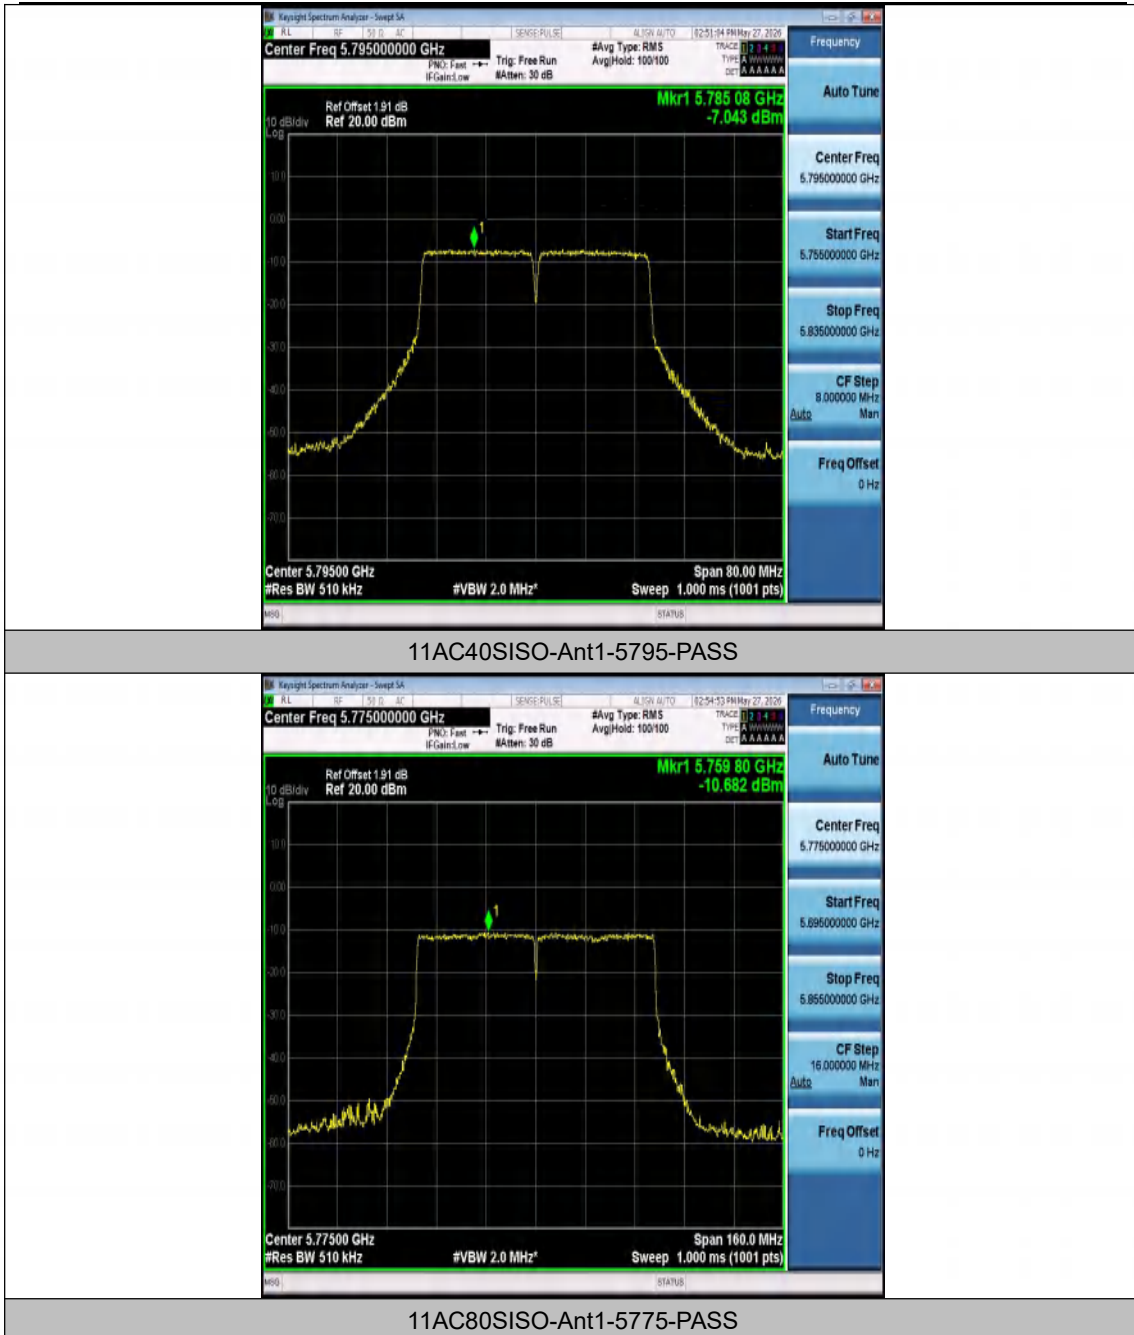

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

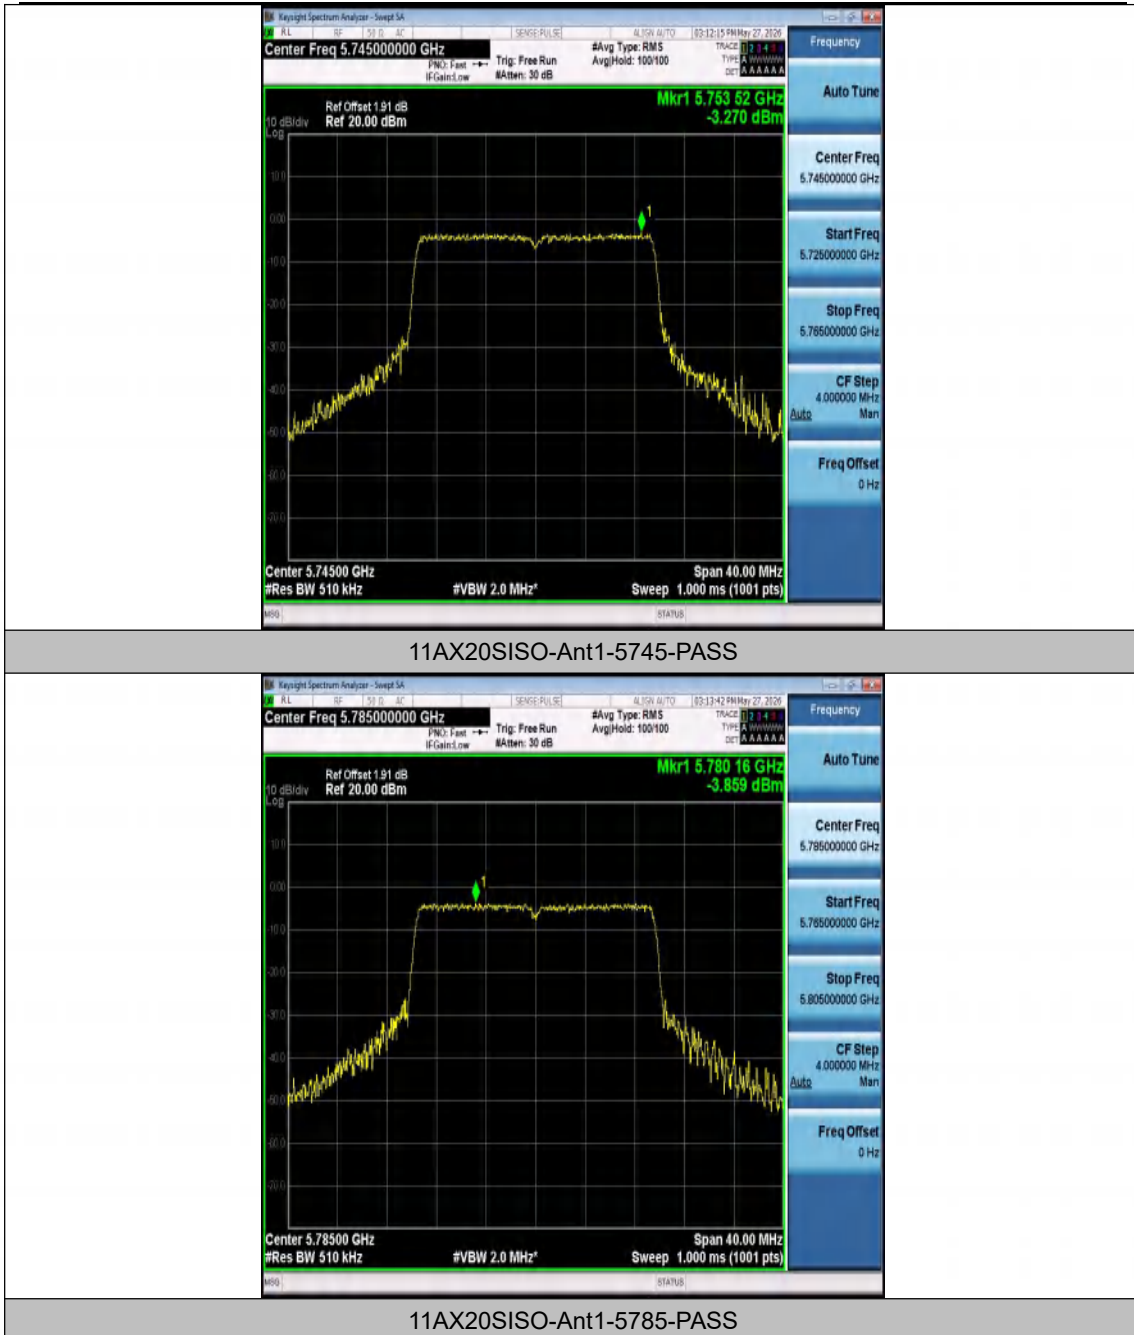

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

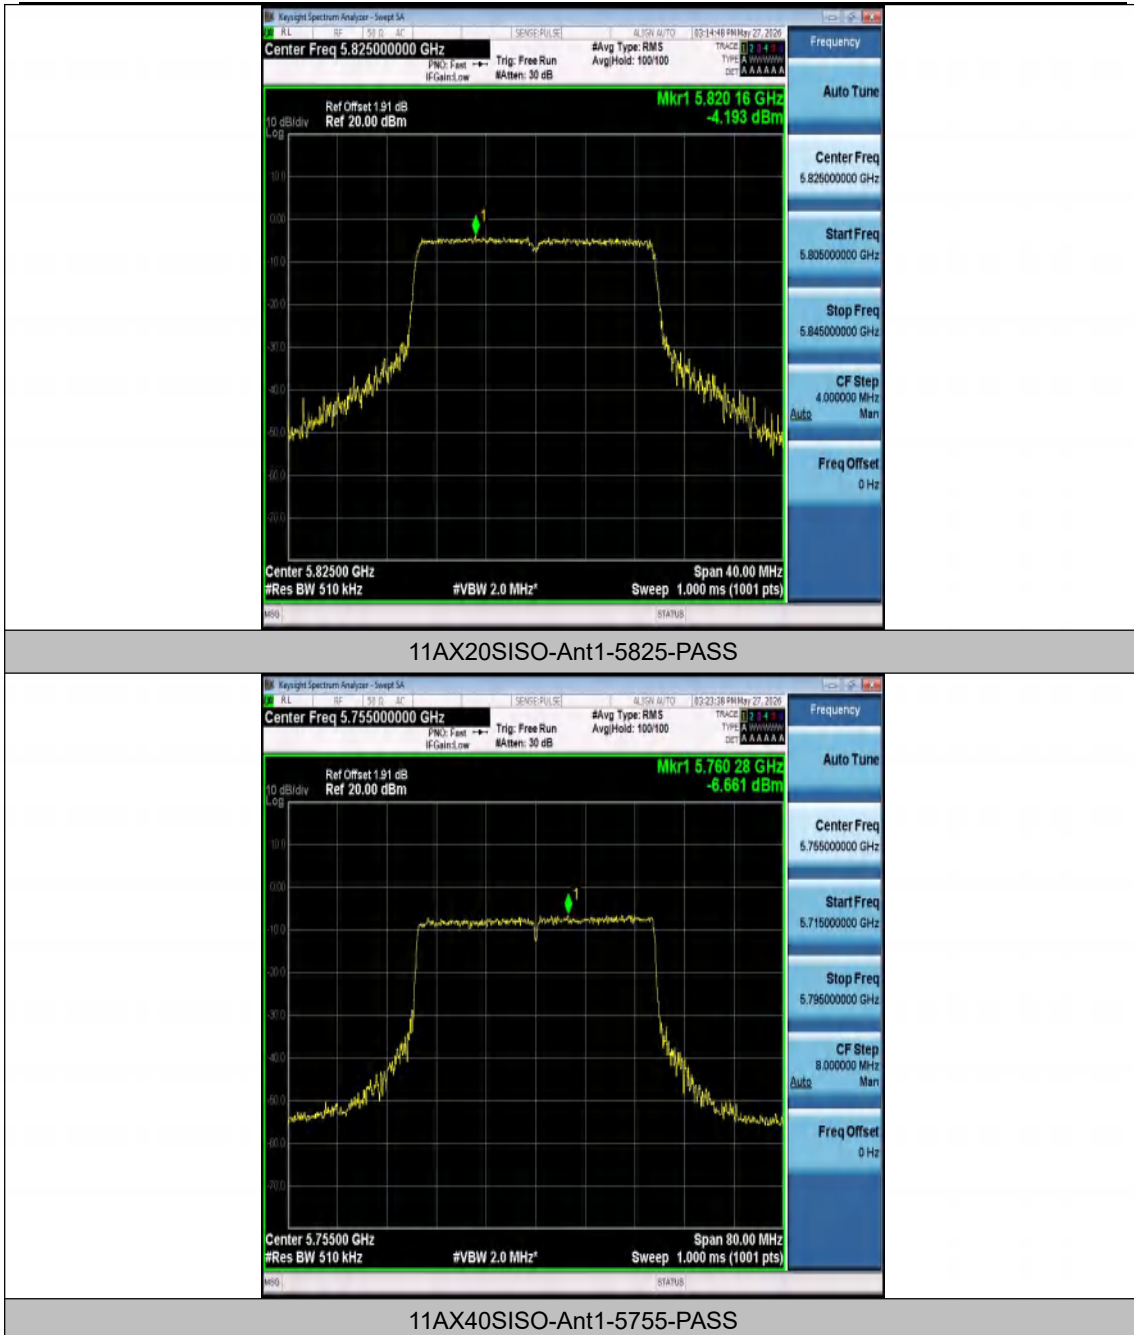

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

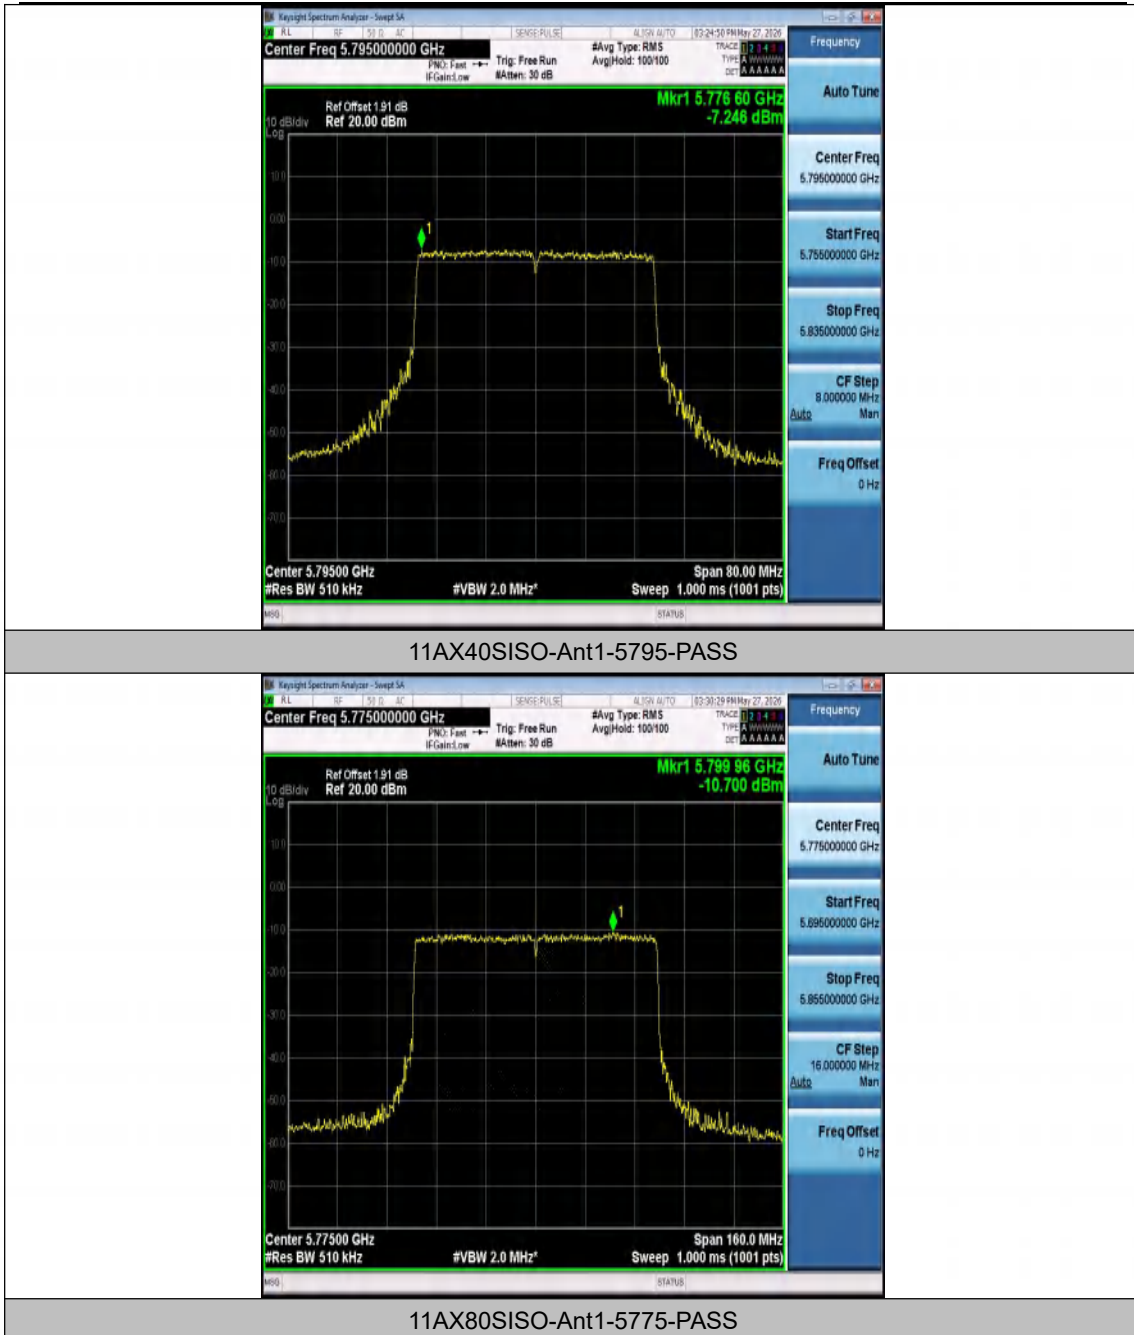

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix E: Band edge measurements

Test Result B1/2/3

Test Mode	Antenna	ChName	Frequency[MHz]	Result[dBm]	Limit[dBm]	Verdict
11A	Ant1	Low	5180	-39.25	≤-27	PASS
11A	Ant1	High	5320	-35.99	≤-27	PASS
11A	Ant1	Low	5500	-35.81	≤-27	PASS
11A	Ant1	High	5700	-30.43	≤-27	PASS
11N20SISO	Ant1	Low	5180	-40.13	≤-27	PASS
11N20SISO	Ant1	High	5320	-39.5	≤-27	PASS
11N20SISO	Ant1	Low	5500	-36.3	≤-27	PASS
11N20SISO	Ant1	High	5700	-31.62	≤-27	PASS
11N40SISO	Ant1	Low	5190	-40.2	≤-27	PASS
11N40SISO	Ant1	High	5310	-36.85	≤-27	PASS
11N40SISO	Ant1	Low	5510	-32.84	≤-27	PASS
11N40SISO	Ant1	High	5670	-37.36	≤-27	PASS
11AC20SISO	Ant1	Low	5180	-41.17	≤-27	PASS
11AC20SISO	Ant1	High	5320	-38.55	≤-27	PASS
11AC20SISO	Ant1	Low	5500	-36.41	≤-27	PASS
11AC20SISO	Ant1	High	5700	-32.21	≤-27	PASS
11AC40SISO	Ant1	Low	5190	-40.85	≤-27	PASS
11AC40SISO	Ant1	High	5310	-35.38	≤-27	PASS
11AC40SISO	Ant1	Low	5510	-34.75	≤-27	PASS
11AC40SISO	Ant1	High	5670	-35.04	≤-27	PASS
11AC80SISO	Ant1	Low	5210	-36.88	≤-27	PASS
11AC80SISO	Ant1	High	5290	-34.44	≤-27	PASS
11AC80SISO	Ant1	Low	5530	-29.31	≤-27	PASS
11AX20SISO	Ant1	Low	5180	-44.39	≤-27	PASS
11AX20SISO	Ant1	High	5320	-39.15	≤-27	PASS
11AX20SISO	Ant1	Low	5500	-33.13	≤-27	PASS
11AX20SISO	Ant1	High	5700	-31.43	≤-27	PASS
11AX40SISO	Ant1	Low	5190	-40.05	≤-27	PASS
11AX40SISO	Ant1	High	5310	-35.44	≤-27	PASS
11AX40SISO	Ant1	Low	5510	-29.87	≤-27	PASS
11AX40SISO	Ant1	High	5670	-36.55	≤-27	PASS
11AX80SISO	Ant1	Low	5210	-32.83	≤-27	PASS
11AX80SISO	Ant1	High	5290	-28.07	≤-27	PASS
11AX80SISO	Ant1	Low	5530	-31.54	≤-27	PASS

Note: Offset=cable loss+Antenna gain,U-NIII-1 gain:1dBi,U-NIII-2A gain:2.11dBi,U-NIII-2C gain:2.80dBi


Test Result B4

Test Mode	Antenna	Ch. Name	Frequency [MHz]	FreqRange [MHz]	Result [dBm]	Limit [dBm]	Verdict
11A	Ant1	Low	5745	5720~5725	-33.96	≤15.82	PASS
11A	Ant1	Low	5745	5700~5720	-30.69	≤13.24	PASS
11A	Ant1	Low	5745	5650~5700	-45.47	≤-26.96	PASS
11A	Ant1	Low	5745	5645~5650	-45.82	≤-27	PASS
11A	Ant1	High	5825	5850~5855	-30.28	≤21.88	PASS
11A	Ant1	High	5825	5855~5875	-31.52	≤15.43	PASS
11A	Ant1	High	5825	5875~5925	-47.41	≤-26.51	PASS
11A	Ant1	High	5825	5925~5935	-46.07	≤-27	PASS
11N20SISO	Ant1	Low	5745	5720~5725	-26.76	≤20.80	PASS
11N20SISO	Ant1	Low	5745	5700~5720	-30.06	≤14.34	PASS
11N20SISO	Ant1	Low	5745	5650~5700	-46.44	≤-26.36	PASS
11N20SISO	Ant1	Low	5745	5645~5650	-46.47	≤-27	PASS
11N20SISO	Ant1	High	5825	5850~5855	-33.81	≤16.96	PASS
11N20SISO	Ant1	High	5825	5855~5875	-38.88	≤14.59	PASS
11N20SISO	Ant1	High	5825	5875~5925	-47.47	≤-26.91	PASS
11N20SISO	Ant1	High	5825	5925~5935	-45.44	≤-27	PASS
11N40SISO	Ant1	Low	5755	5720~5725	-31.42	≤16.04	PASS
11N40SISO	Ant1	Low	5755	5700~5720	-26.18	≤14.63	PASS
11N40SISO	Ant1	Low	5755	5650~5700	-44.11	≤-26.40	PASS
11N40SISO	Ant1	Low	5755	5645~5650	-42.83	≤-27	PASS
11N40SISO	Ant1	High	5795	5850~5855	-37.63	≤18.29	PASS
11N40SISO	Ant1	High	5795	5855~5875	-37.9	≤15.05	PASS
11N40SISO	Ant1	High	5795	5875~5925	-46.92	≤-26.59	PASS
11N40SISO	Ant1	High	5795	5925~5935	-45.79	≤-27	PASS
11AC20SISO	Ant1	Low	5745	5720~5725	-34.28	≤17.13	PASS
11AC20SISO	Ant1	Low	5745	5700~5720	-30.02	≤14.76	PASS
11AC20SISO	Ant1	Low	5745	5650~5700	-46.36	≤-26.96	PASS
11AC20SISO	Ant1	Low	5745	5645~5650	-45.76	≤-27	PASS
11AC20SISO	Ant1	High	5825	5850~5855	-42.6	≤15.73	PASS
11AC20SISO	Ant1	High	5825	5855~5875	-33.52	≤14.67	PASS
11AC20SISO	Ant1	High	5825	5875~5925	-44.14	≤-26.81	PASS
11AC20SISO	Ant1	High	5825	5925~5935	-45.92	≤-27	PASS
11AC40SISO	Ant1	Low	5755	5720~5725	-28.69	≤18.20	PASS
11AC40SISO	Ant1	Low	5755	5700~5720	-31.16	≤13.42	PASS
11AC40SISO	Ant1	Low	5755	5650~5700	-45.99	≤-26.70	PASS
11AC40SISO	Ant1	Low	5755	5645~5650	-46.16	≤-27	PASS
11AC40SISO	Ant1	High	5795	5850~5855	-38.77	≤18.29	PASS
11AC40SISO	Ant1	High	5795	5855~5875	-38.69	≤15.28	PASS

11AC40SISO	Ant1	High	5795	5875~5925	-46.75	≤-26.59	PASS
11AC40SISO	Ant1	High	5795	5925~5935	-46.14	≤-27	PASS
11AC80SISO	Ant1	Low	5775	5720~5725	-24.84	≤16.71	PASS
11AC80SISO	Ant1	Low	5775	5700~5720	-25.76	≤14.22	PASS
11AC80SISO	Ant1	Low	5775	5650~5700	-43.94	≤-24.62	PASS
11AC80SISO	Ant1	Low	5775	5645~5650	-43.81	≤-27	PASS
11AC80SISO	Ant1	High	5775	5850~5855	-30.83	≤16.26	PASS
11AC80SISO	Ant1	High	5775	5855~5875	-33.49	≤12.73	PASS
11AC80SISO	Ant1	High	5775	5875~5925	-43.98	≤-24.82	PASS
11AC80SISO	Ant1	High	5775	5925~5935	-44.91	≤-27	PASS
11AX20SISO	Ant1	Low	5745	5720~5725	-24.42	≤18.70	PASS
11AX20SISO	Ant1	Low	5745	5700~5720	-27.73	≤15.59	PASS
11AX20SISO	Ant1	Low	5745	5650~5700	-47.05	≤-26.79	PASS
11AX20SISO	Ant1	Low	5745	5645~5650	-45.35	≤-27	PASS
11AX20SISO	Ant1	High	5825	5850~5855	-26.95	≤20.03	PASS
11AX20SISO	Ant1	High	5825	5855~5875	-33.07	≤15.50	PASS
11AX20SISO	Ant1	High	5825	5875~5925	-46.44	≤-26.51	PASS
11AX20SISO	Ant1	High	5825	5925~5935	-45.23	≤-27	PASS
11AX40SISO	Ant1	Low	5755	5720~5725	-27.39	≤19.12	PASS
11AX40SISO	Ant1	Low	5755	5700~5720	-30.84	≤14.10	PASS
11AX40SISO	Ant1	Low	5755	5650~5700	-44.47	≤-26.70	PASS
11AX40SISO	Ant1	Low	5755	5645~5650	-45.74	≤-27	PASS
11AX40SISO	Ant1	High	5795	5850~5855	-33.49	≤20.17	PASS
11AX40SISO	Ant1	High	5795	5855~5875	-43.25	≤10.53	PASS
11AX40SISO	Ant1	High	5795	5875~5925	-46.3	≤-26.46	PASS
11AX40SISO	Ant1	High	5795	5925~5935	-45.35	≤-27	PASS
11AX80SISO	Ant1	Low	5775	5720~5725	-27.67	≤17.77	PASS
11AX80SISO	Ant1	Low	5775	5700~5720	-29.29	≤12.61	PASS
11AX80SISO	Ant1	Low	5775	5650~5700	-45.74	≤-26.91	PASS
11AX80SISO	Ant1	Low	5775	5645~5650	-44.63	≤-27	PASS
11AX80SISO	Ant1	High	5775	5850~5855	-38.12	≤15.84	PASS
11AX80SISO	Ant1	High	5775	5855~5875	-39.16	≤10.55	PASS
11AX80SISO	Ant1	High	5775	5875~5925	-46.53	≤-26.87	PASS
11AX80SISO	Ant1	High	5775	5925~5935	-45.52	≤-27	PASS

Note: Offset=cable loss+Antenna gain,U-NIII-3 gain:2.80dBi

Test Graphs B1/2/3

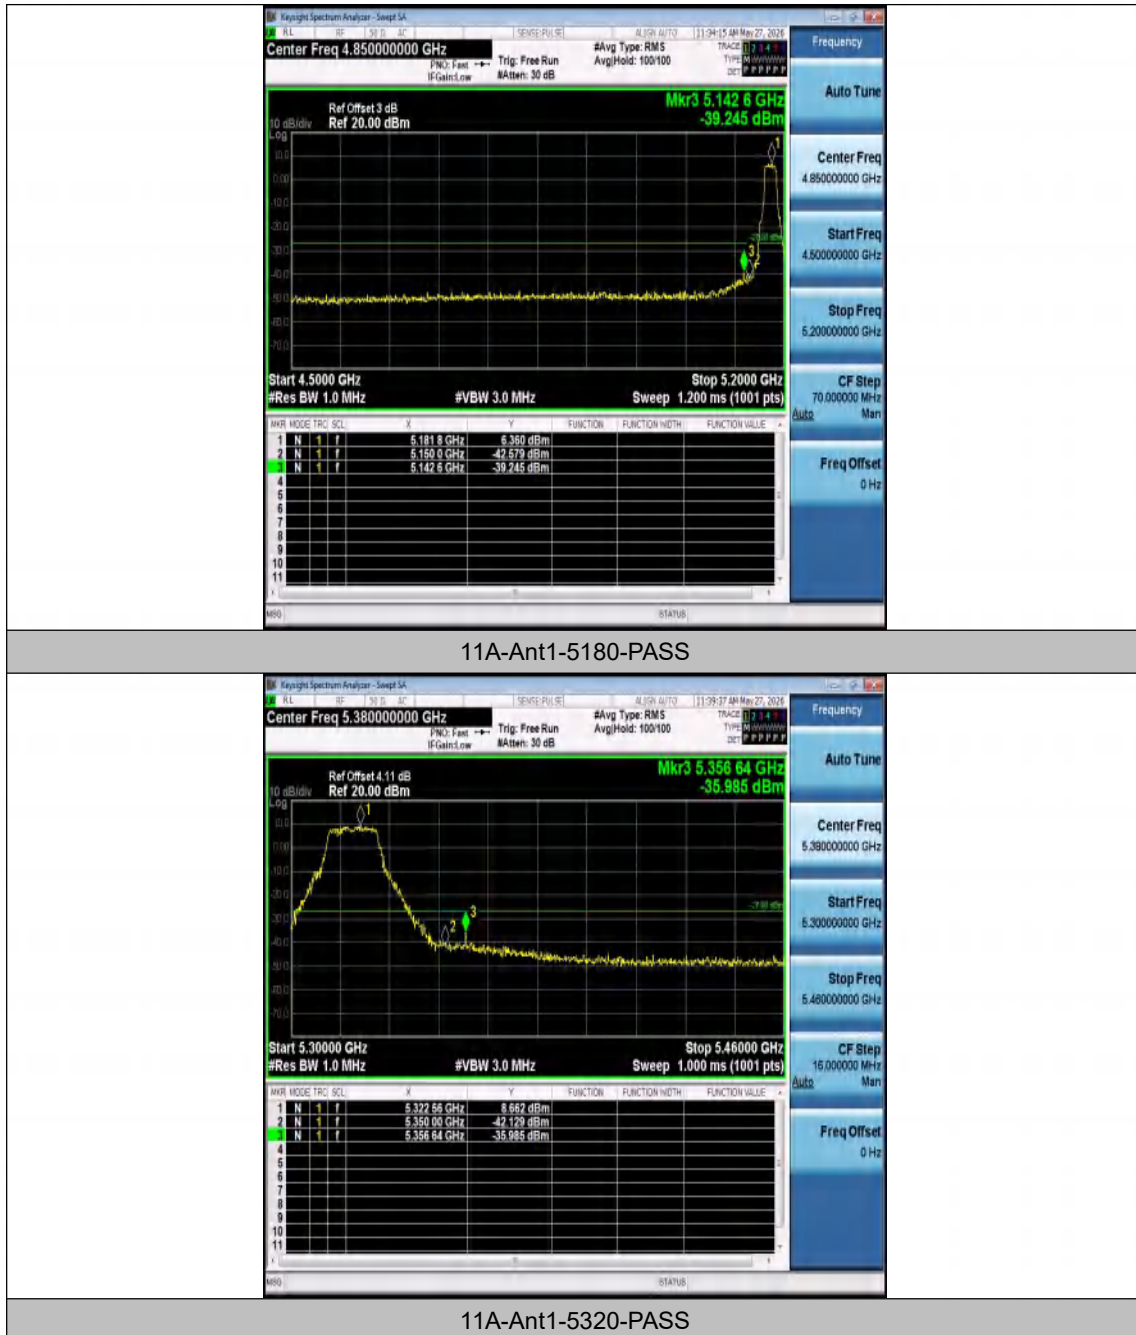


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



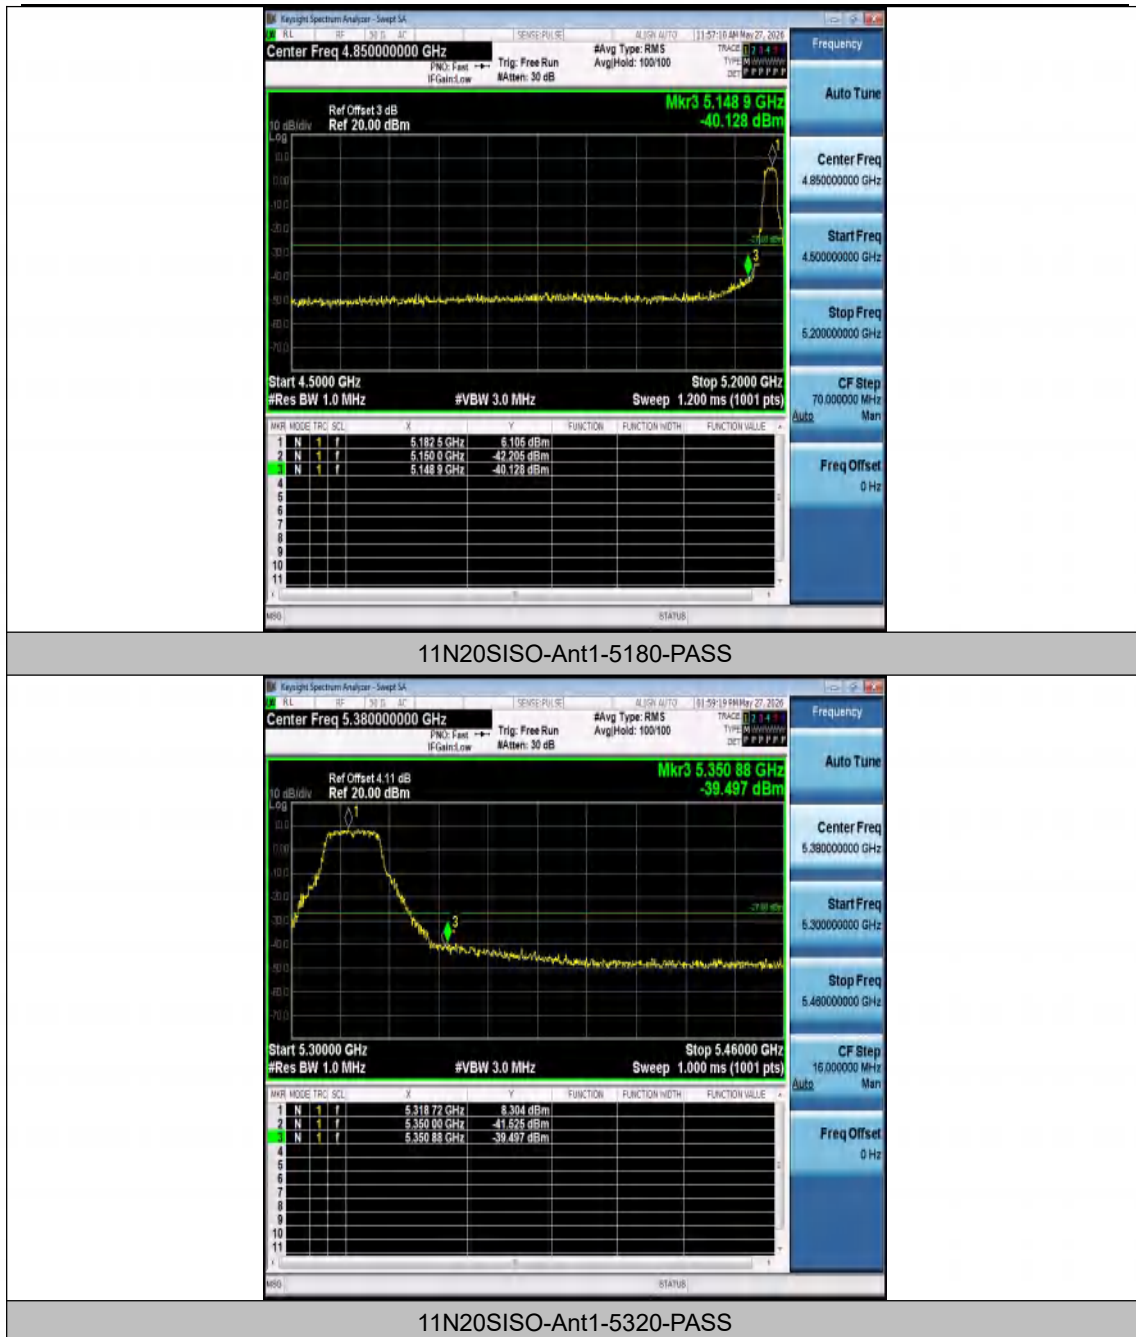


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



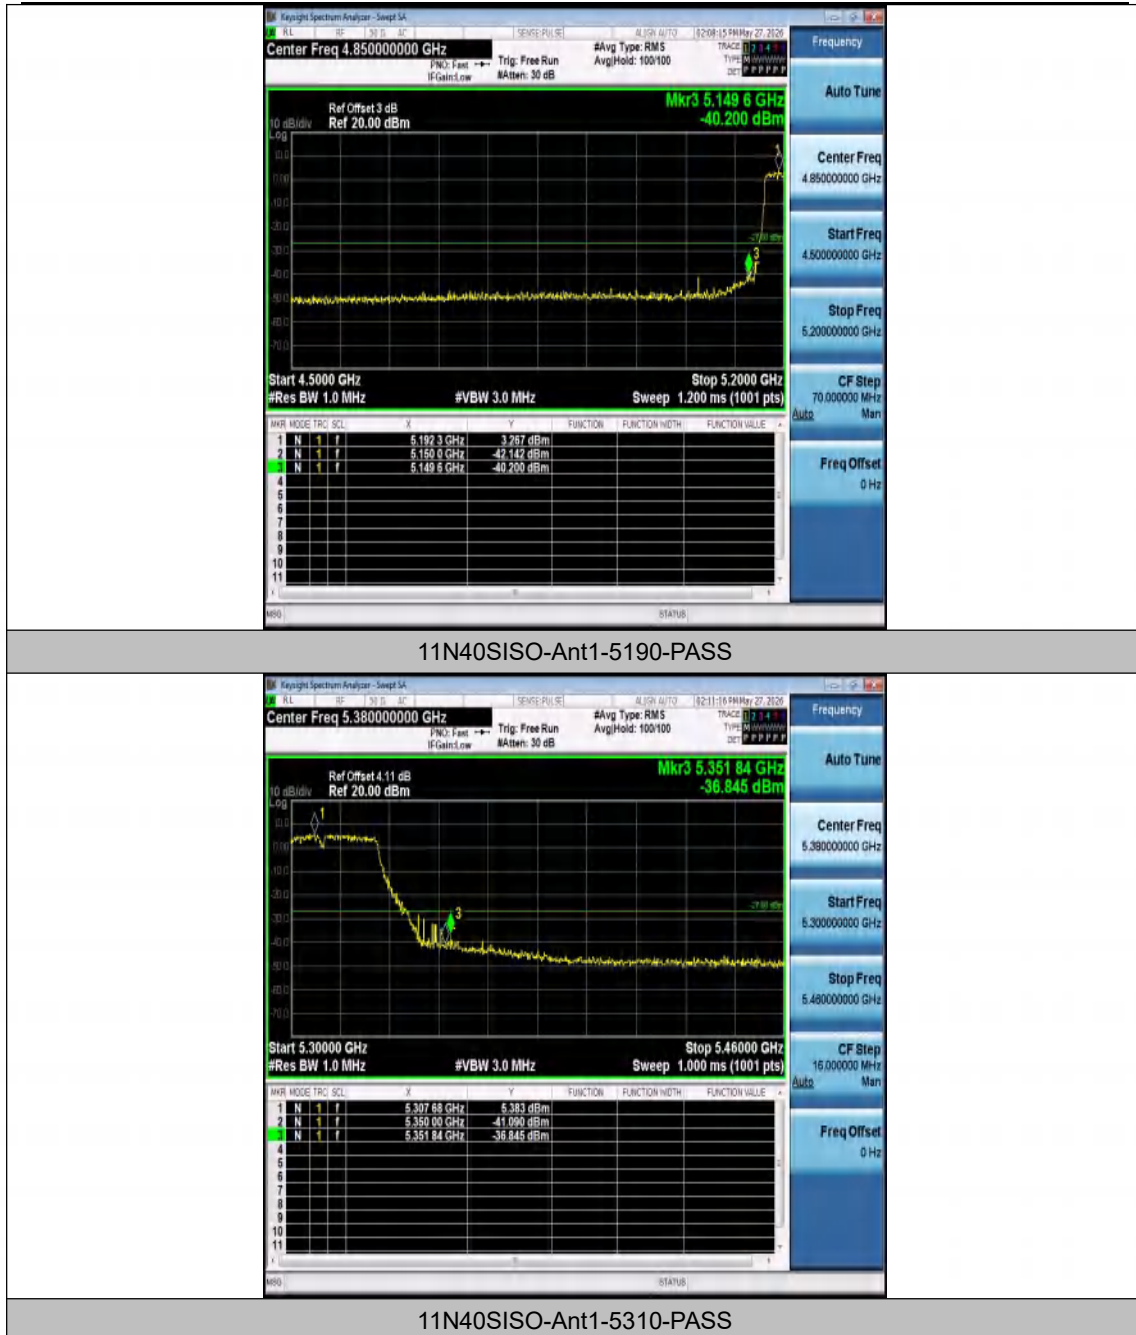

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com




Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

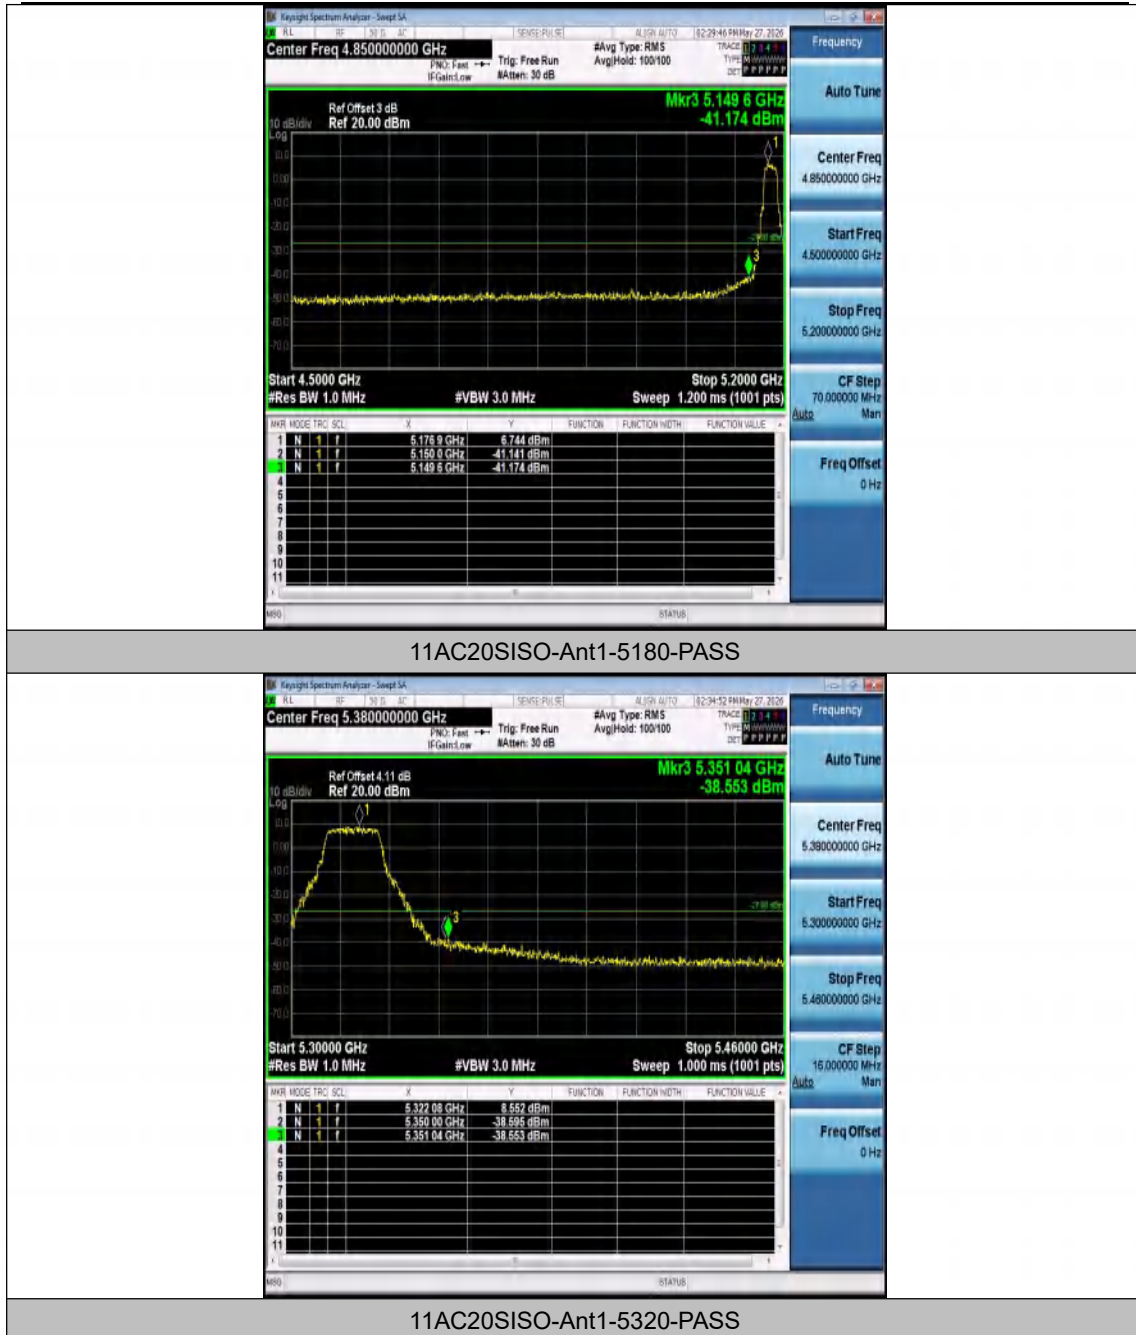




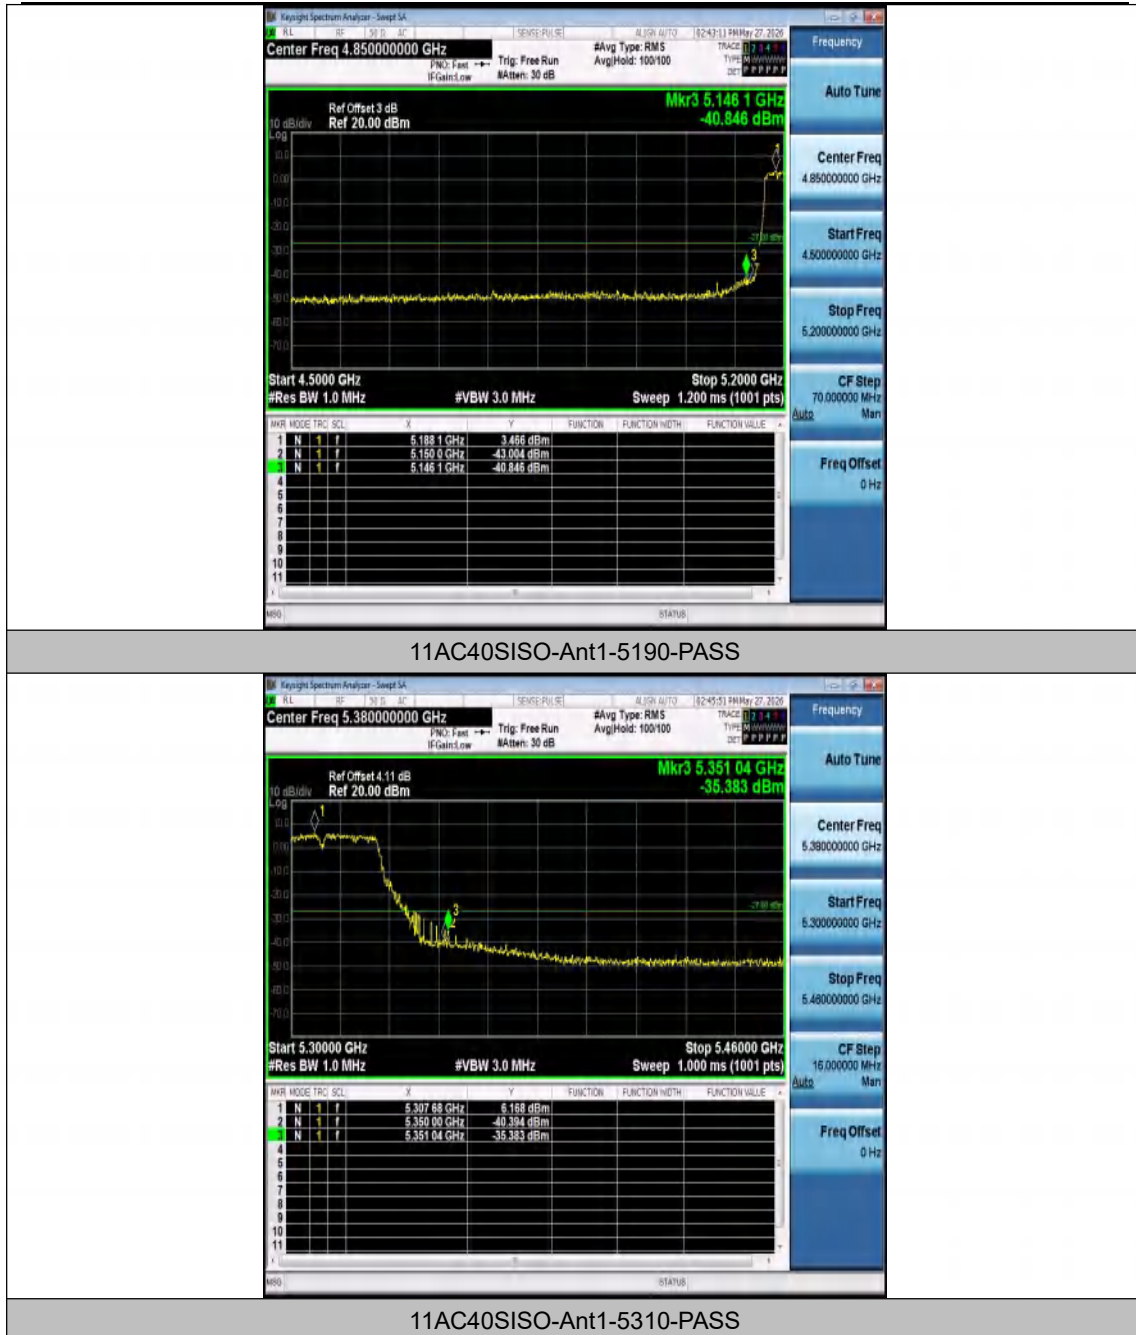

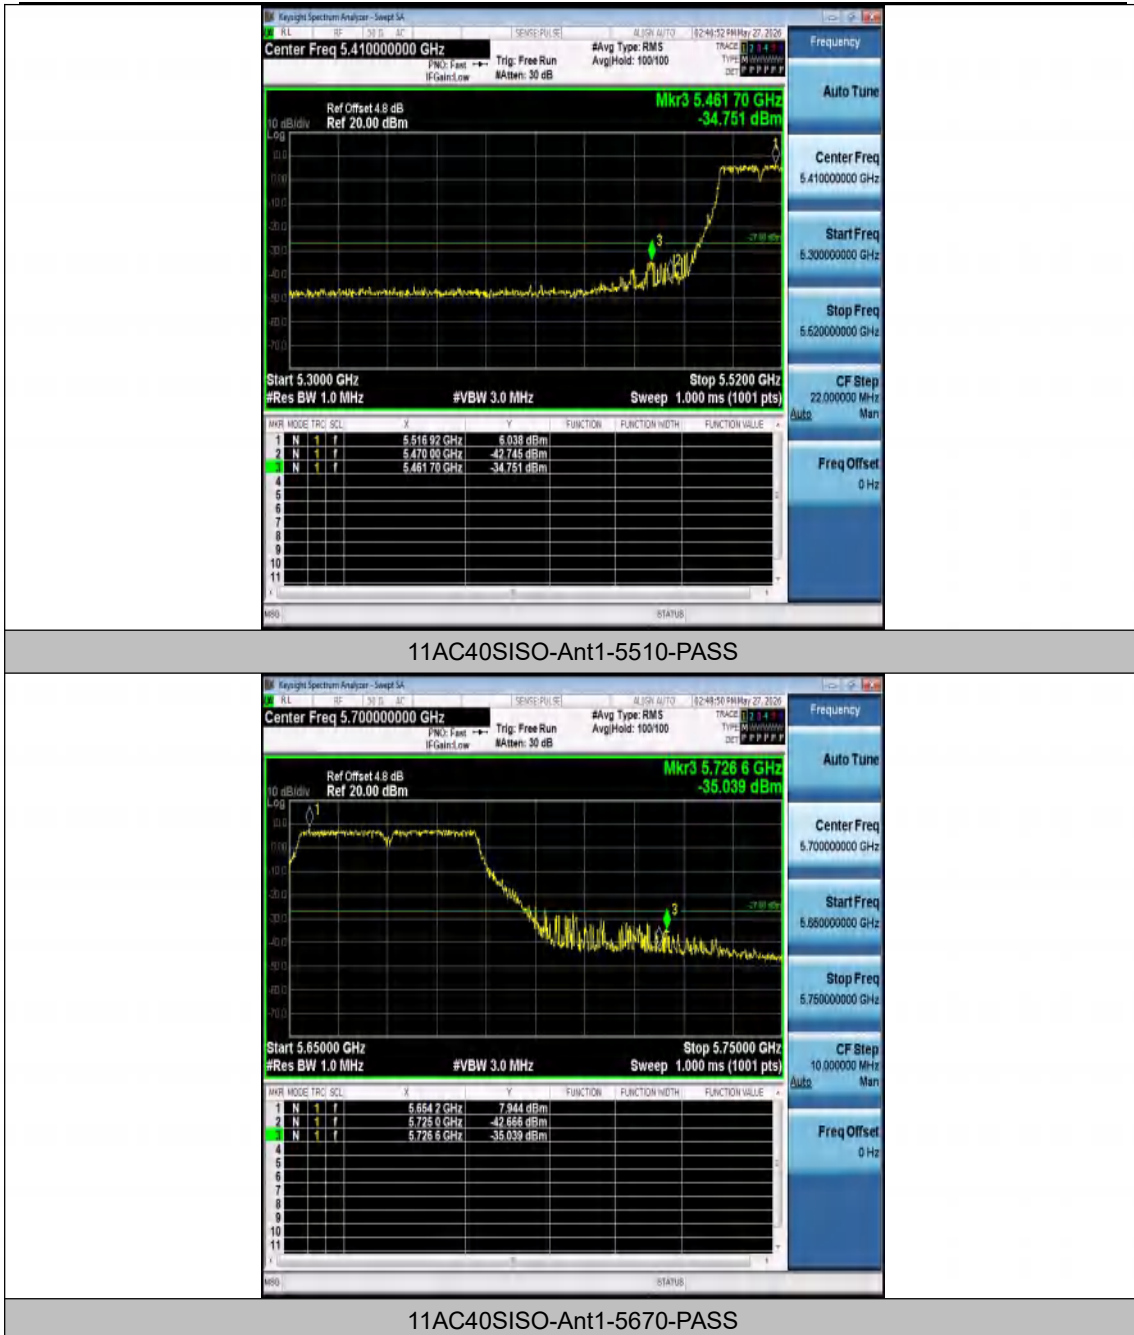

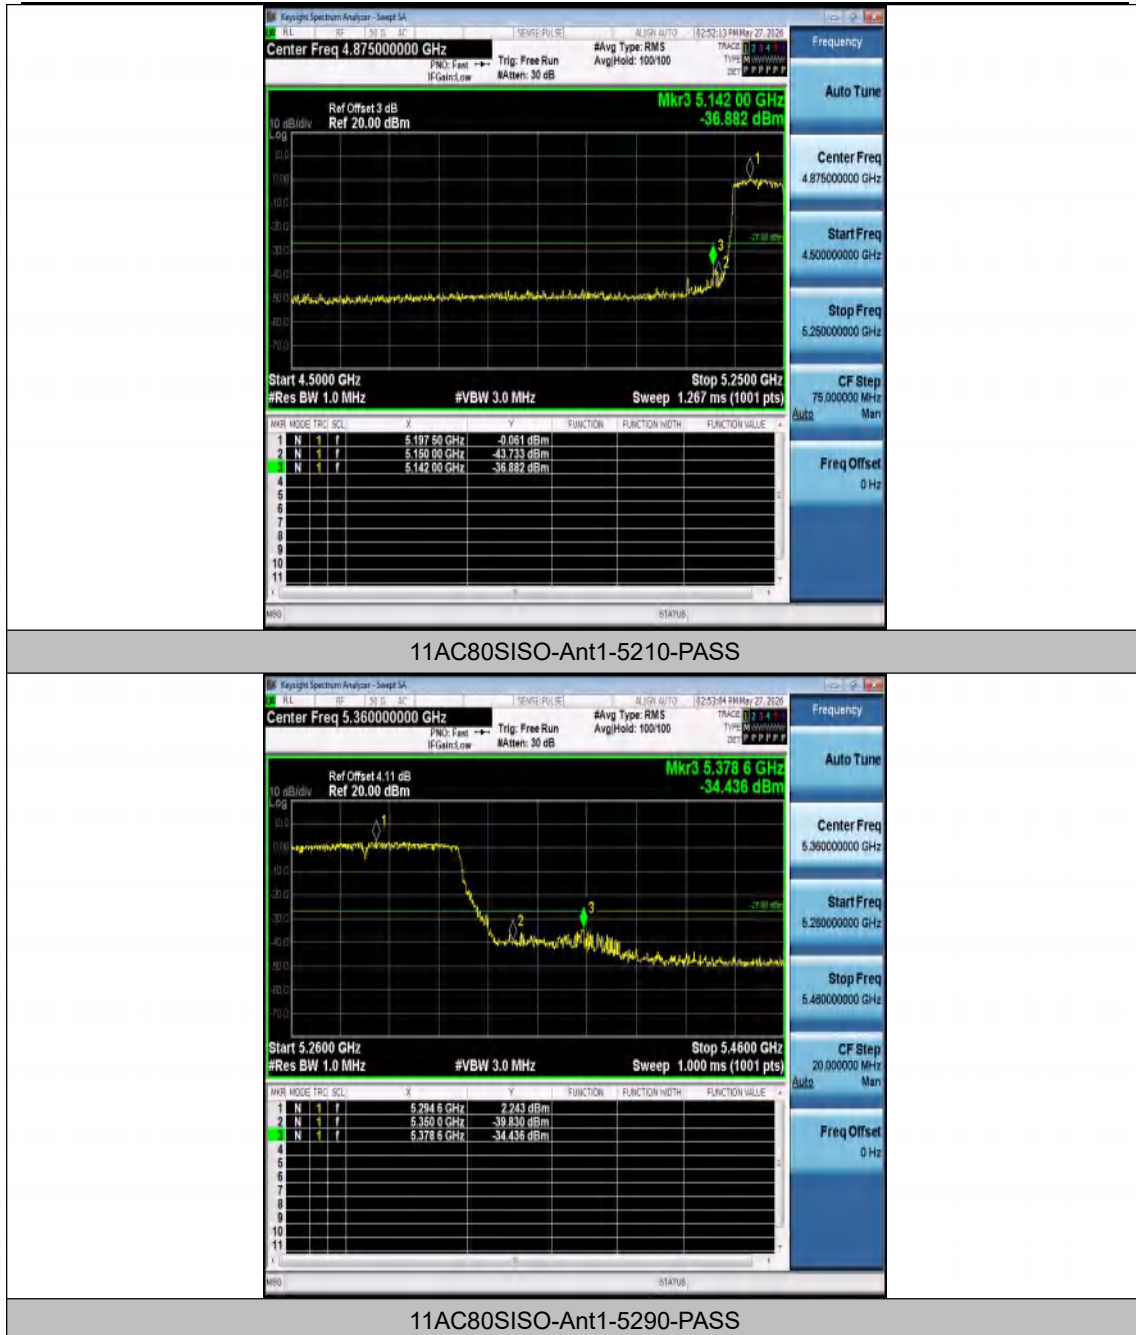



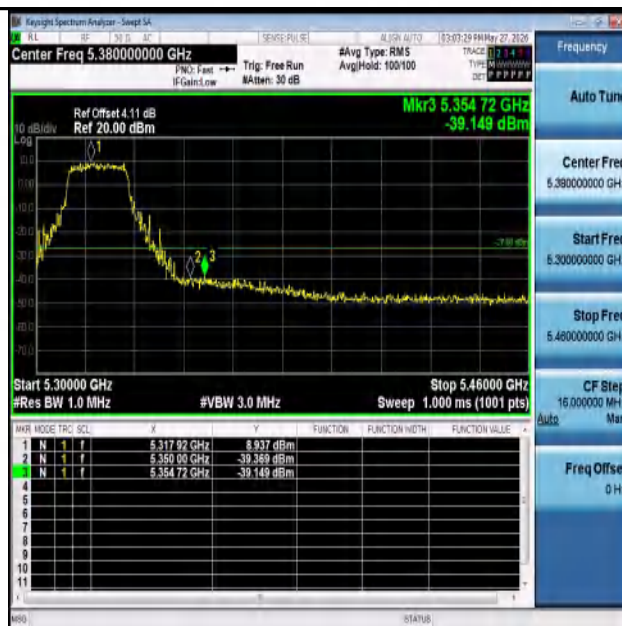

11AX20SISO-Ant1-5320-PASS




11AX20SISO-Ant1-5500-PASS


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

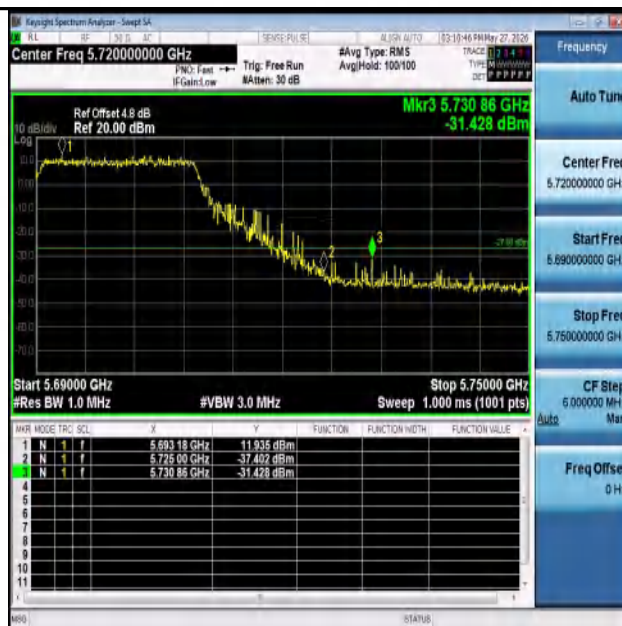

11AX20SISO-Ant1-5700-PASS

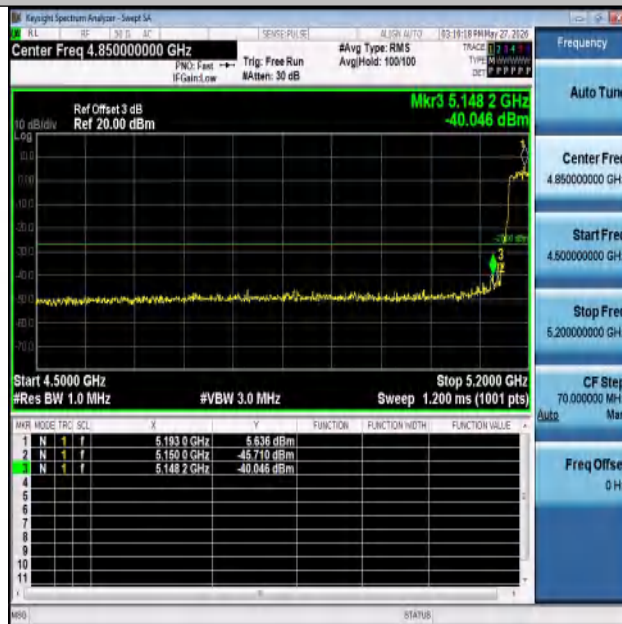



11AX40SISO-Ant1-5190-PASS

Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

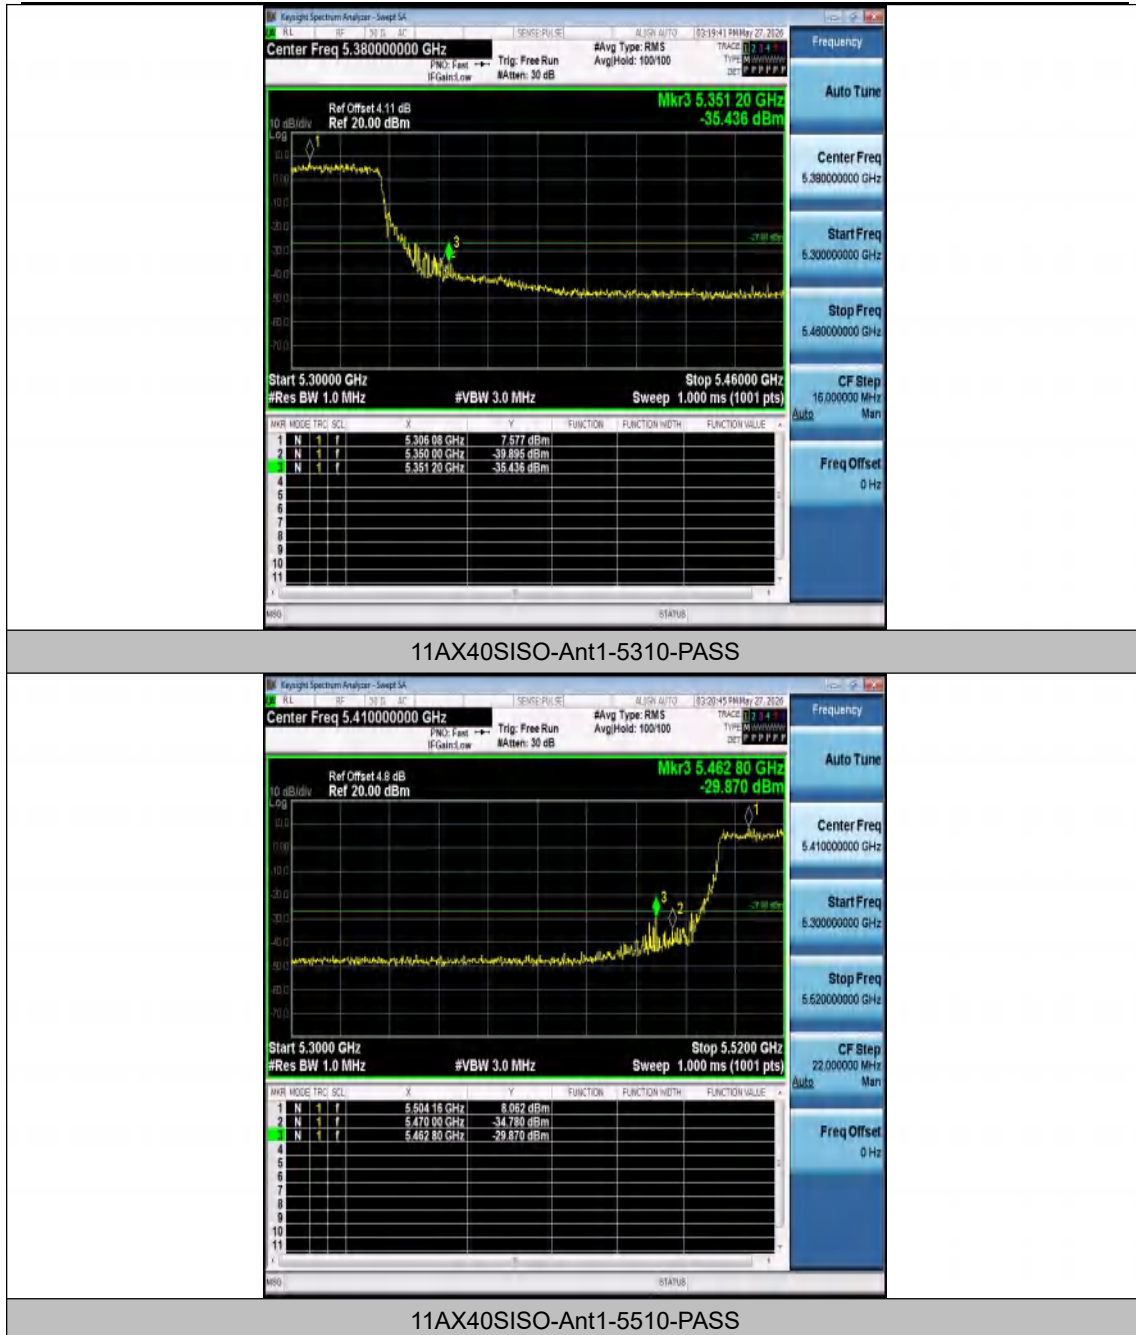

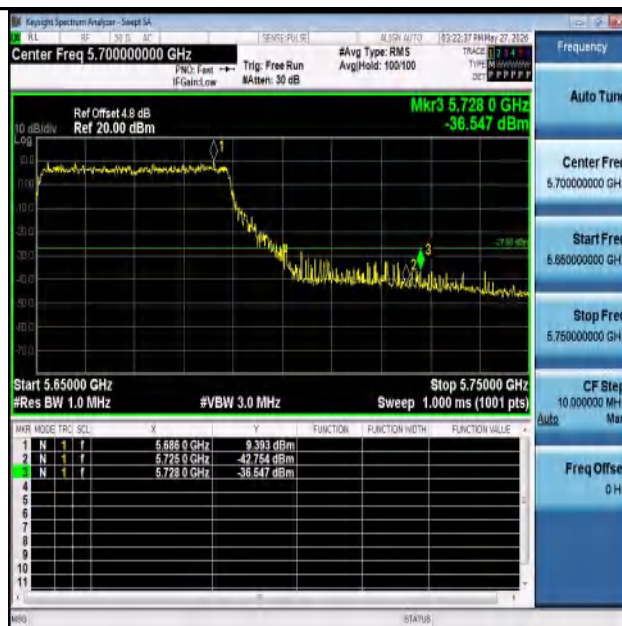

11AX40SISO-Ant1-5670-PASS

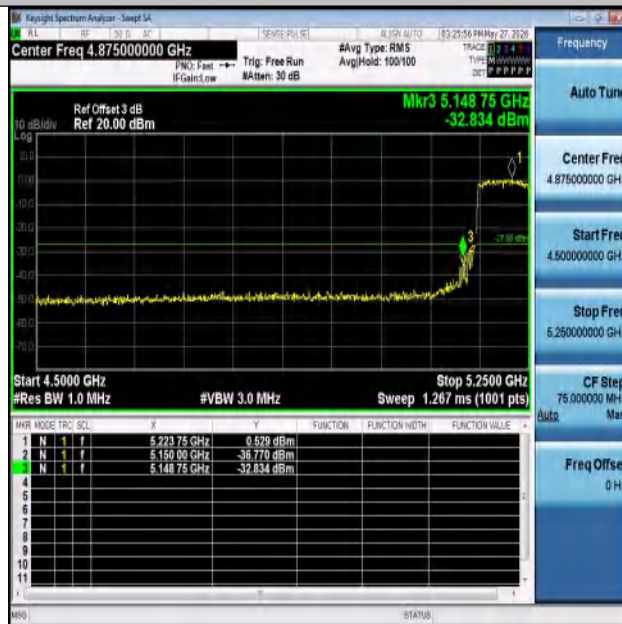


11AX80SISO-Ant1-5210-PASS


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

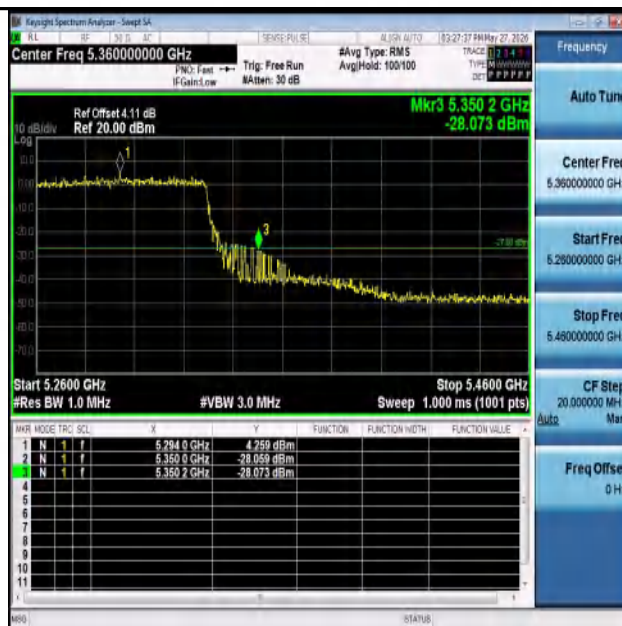

11AX80SISO-Ant1-5290-PASS

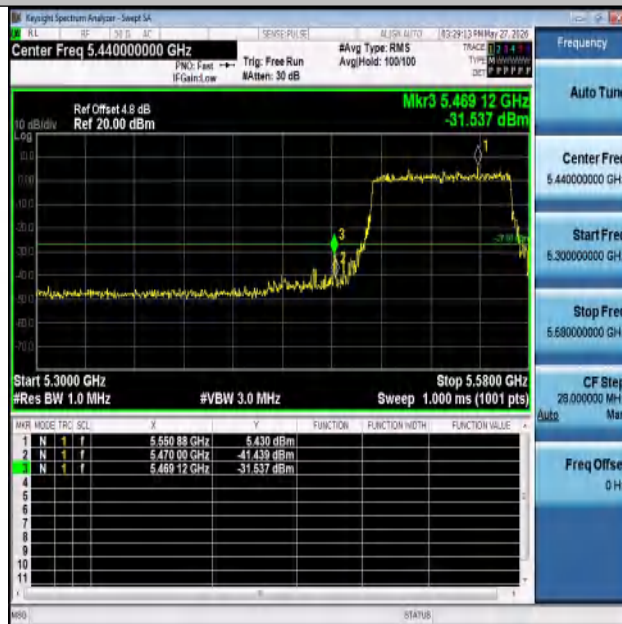

11AX80SISO-Ant1-5530-PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Test Graphs B4






Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

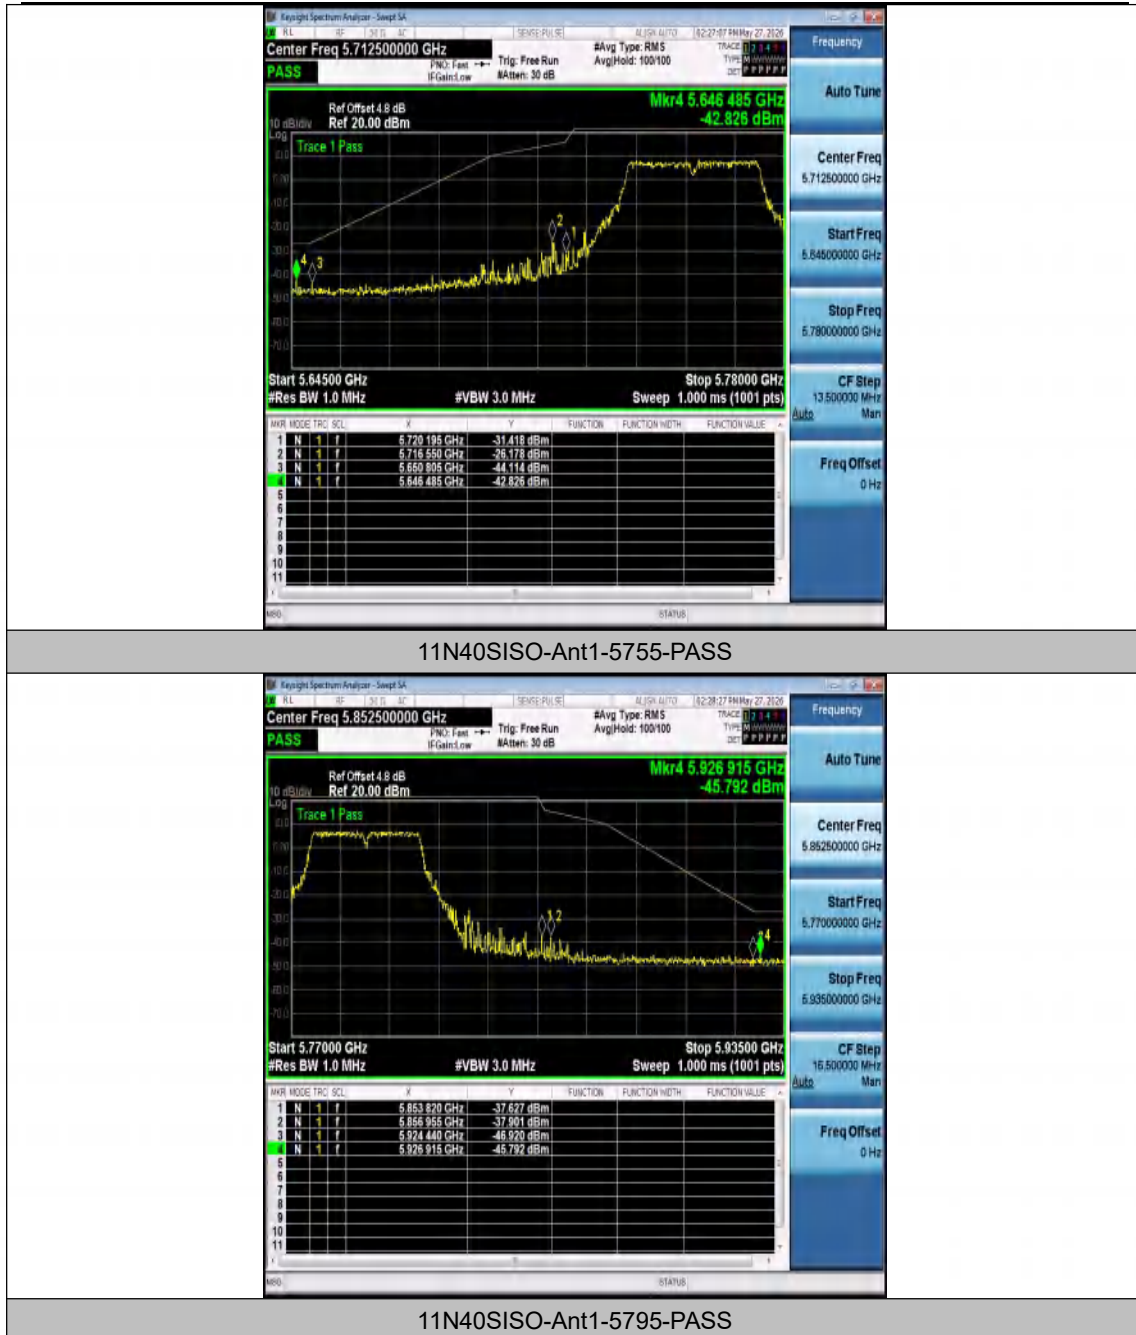


Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com





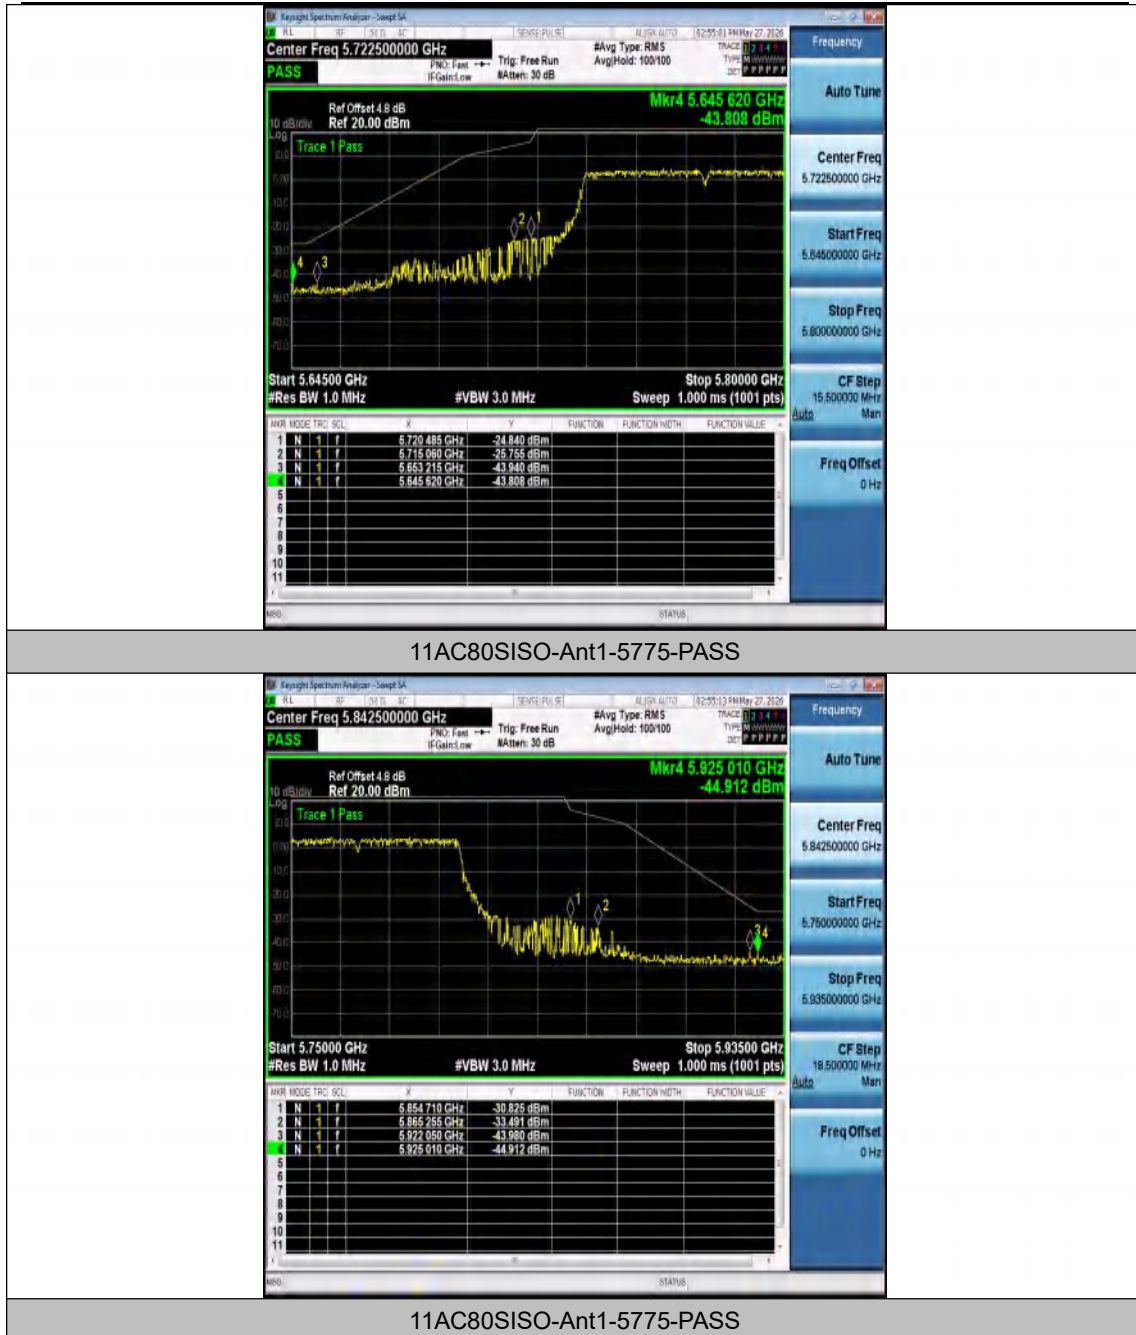

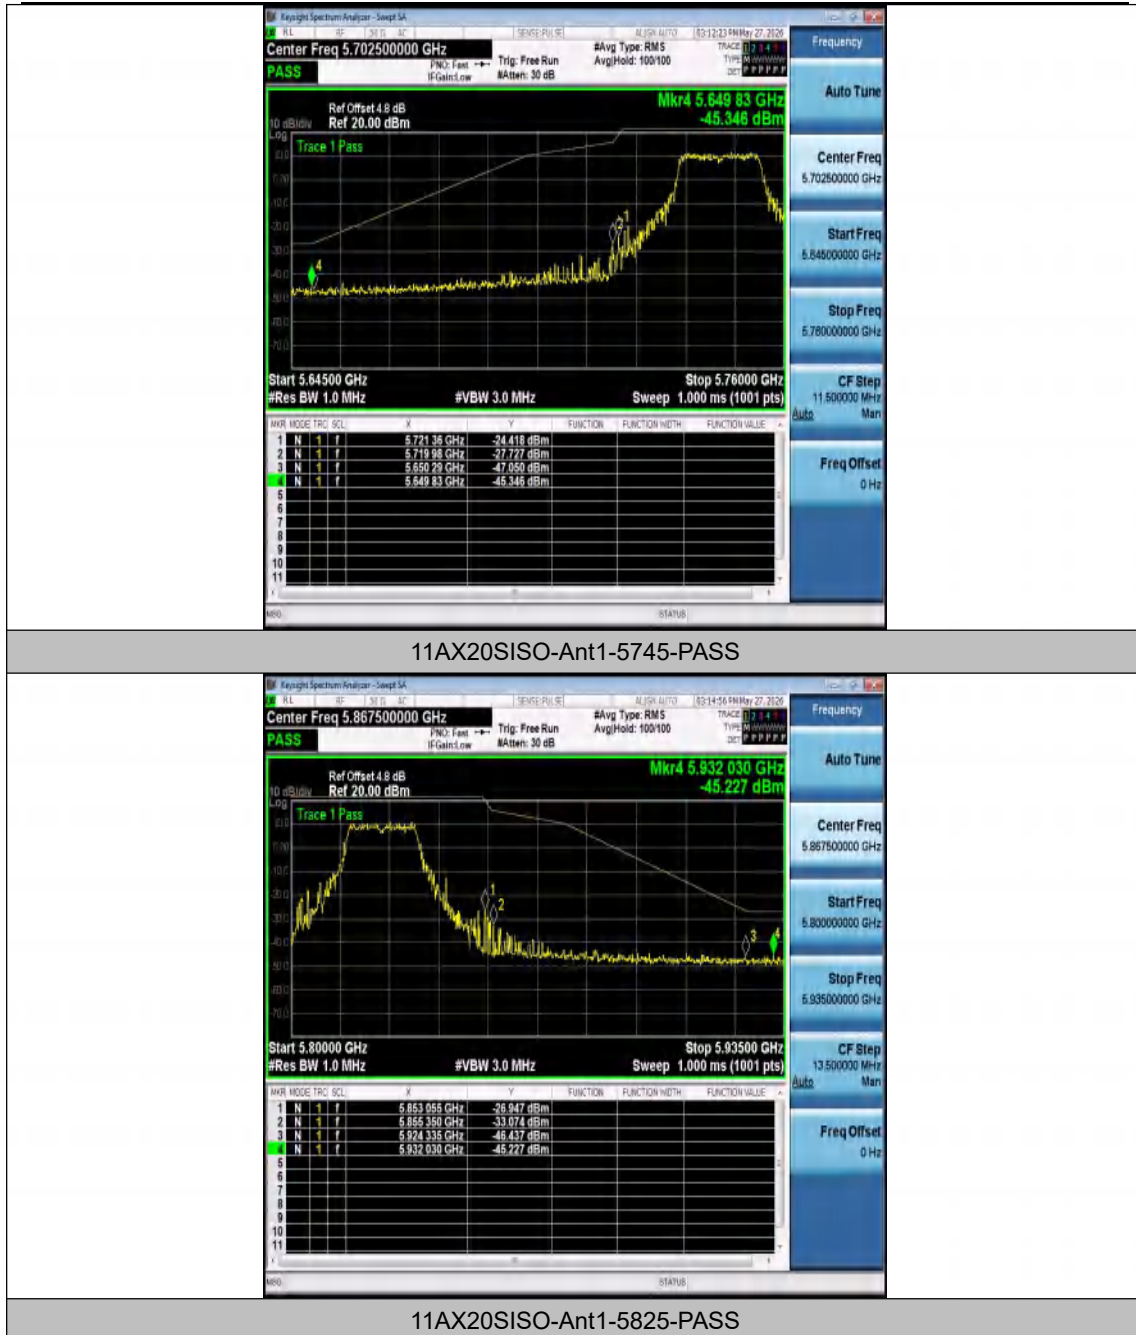

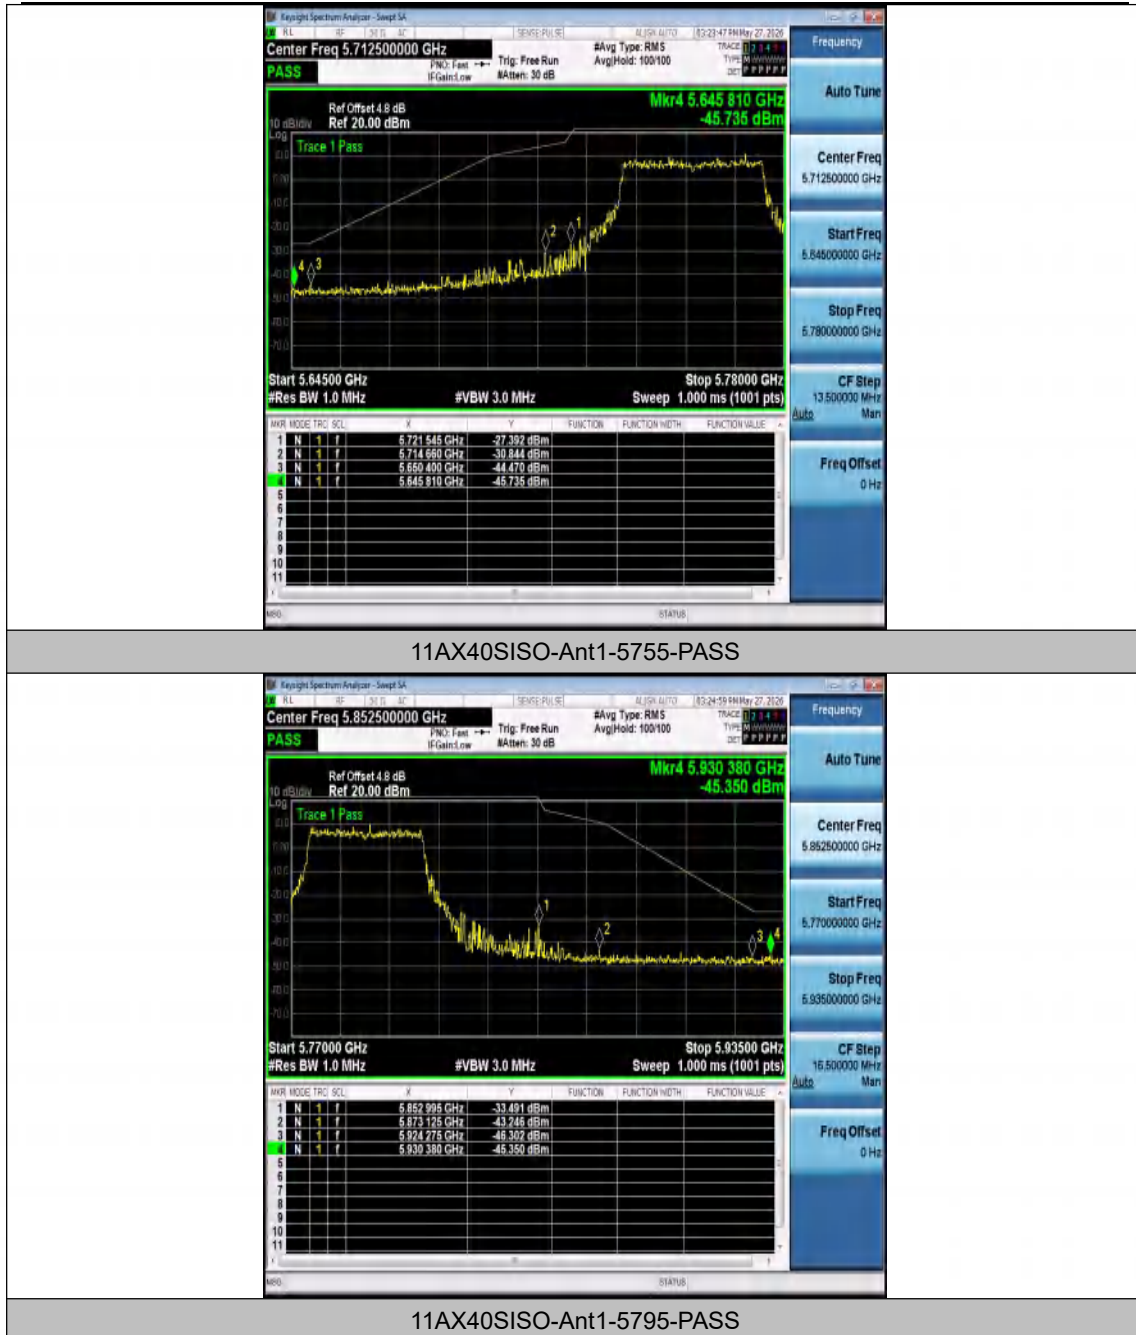




Appendix F: DFS Detection Thresholds

Test Result

TestMode	Frequency[dbm]	Radar Type	Result	Limit[dbm]	Verdict
11A	5320	Type0	-62.15	-62.00	PASS
11A	5700	Type0	-62.08	-62.00	PASS
11AX80SISO	5290	Type0	-62.35	-62.00	PASS
11AX80SISO	5530	Type0	-62.45	-62.00	PASS

Note: The antenna gain is greater than 0dBi, the experiment employed a harsher approach.


Test Graphs

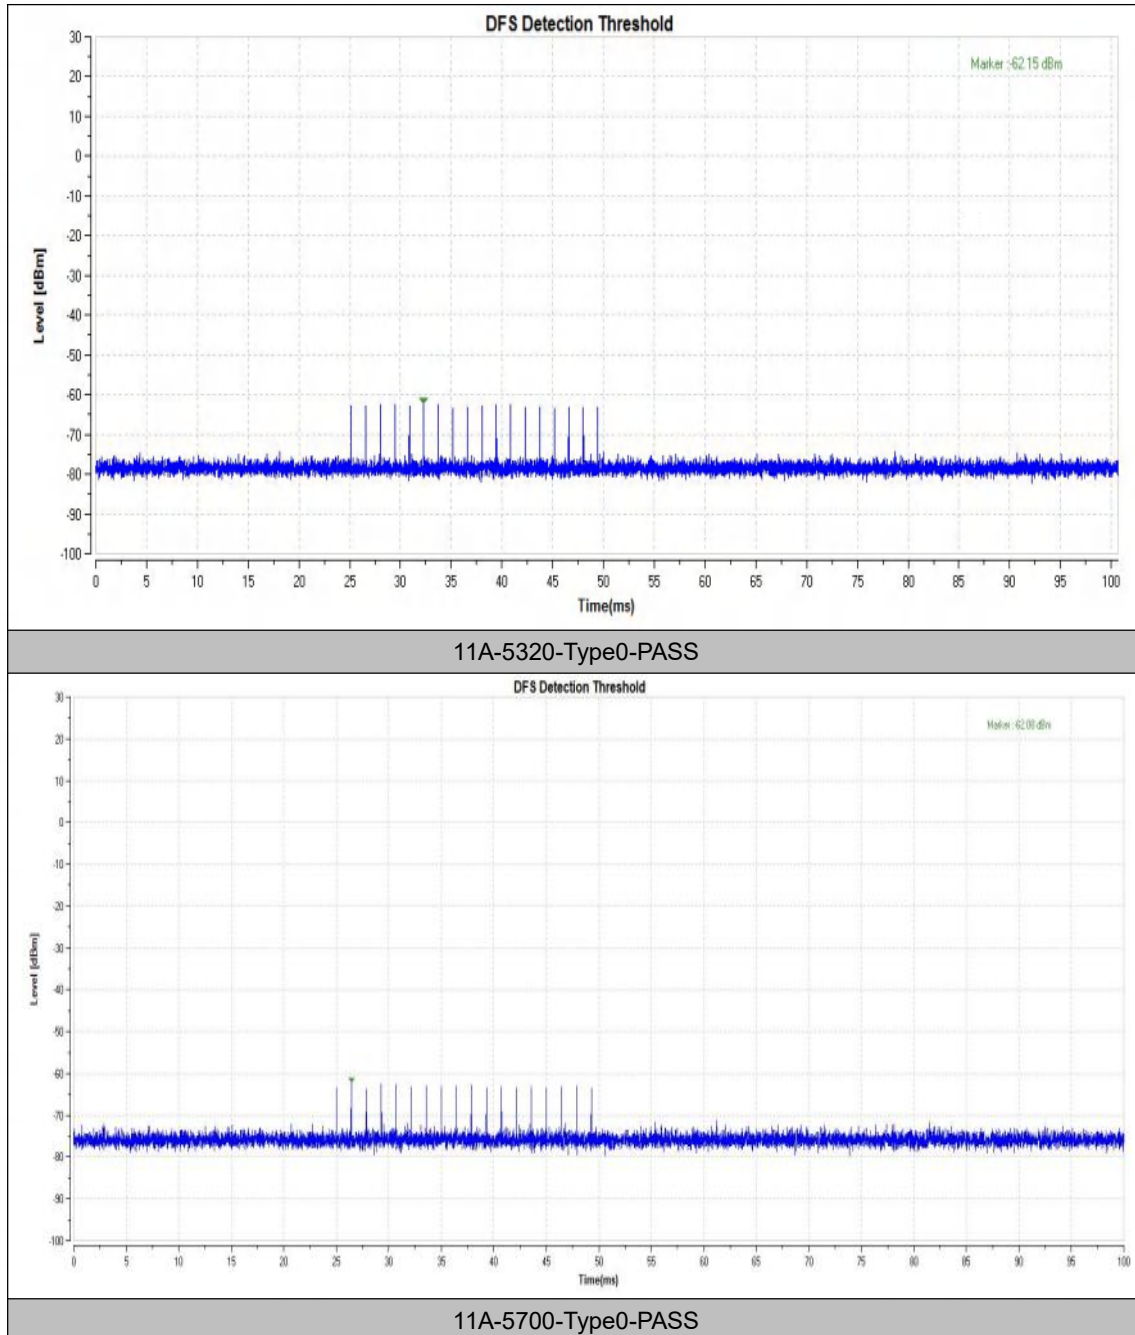

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

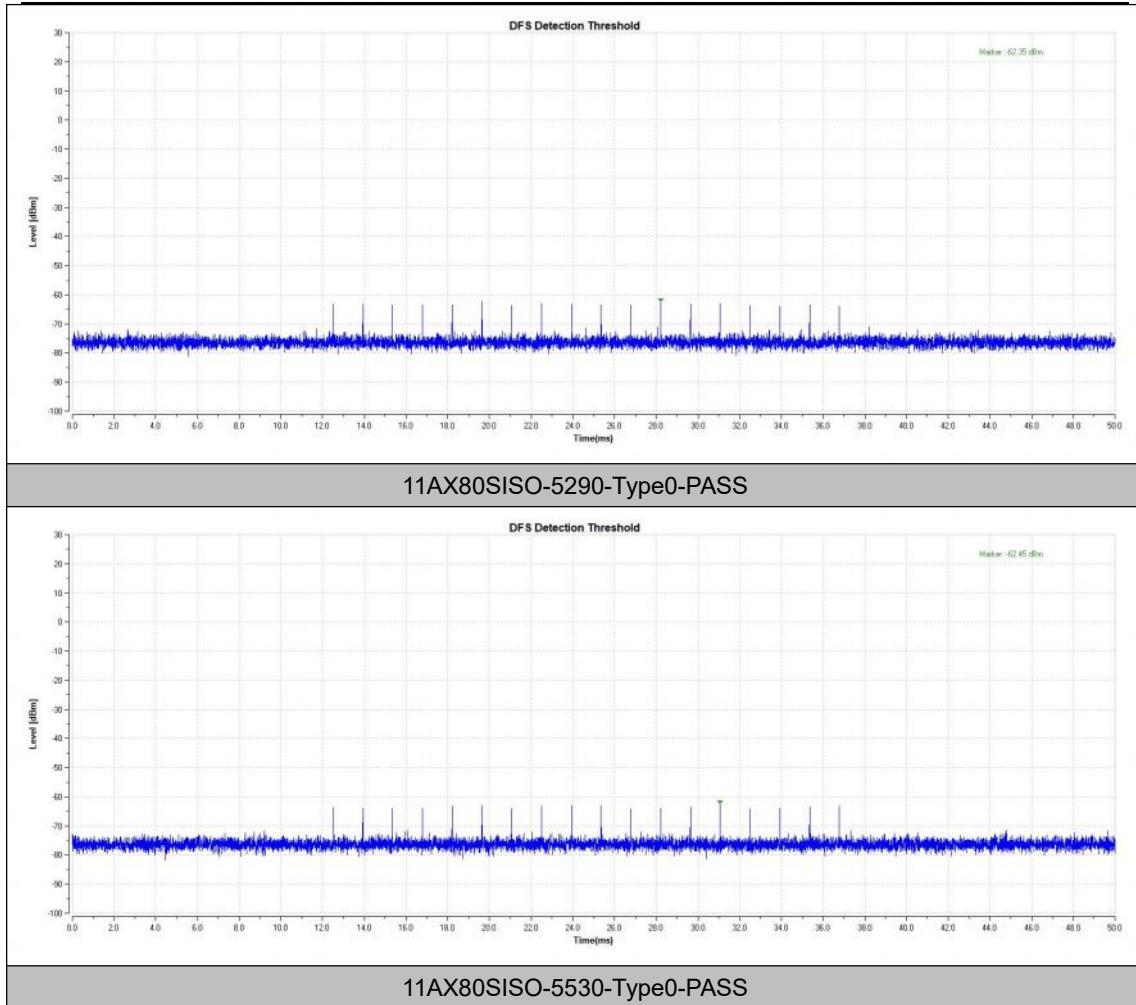


Appendix G: Channel Move Time and Channel Closing


Transmission Time

Test Result


TestMode	Frequency[MHz]	CCTT[ms]	Limit[ms]	CMT[ms]	Limit[ms]	Verdict
11A	5320	200+1.3	200+60	211.8	10000	PASS
11A	5700	200+0	200+60	205.3	10000	PASS
11AX80SISO	5290	200+7.8	200+60	841.1	10000	PASS
11AX80SISO	5530	200+1.3	200+60	207.9	10000	PASS

Test Graphs

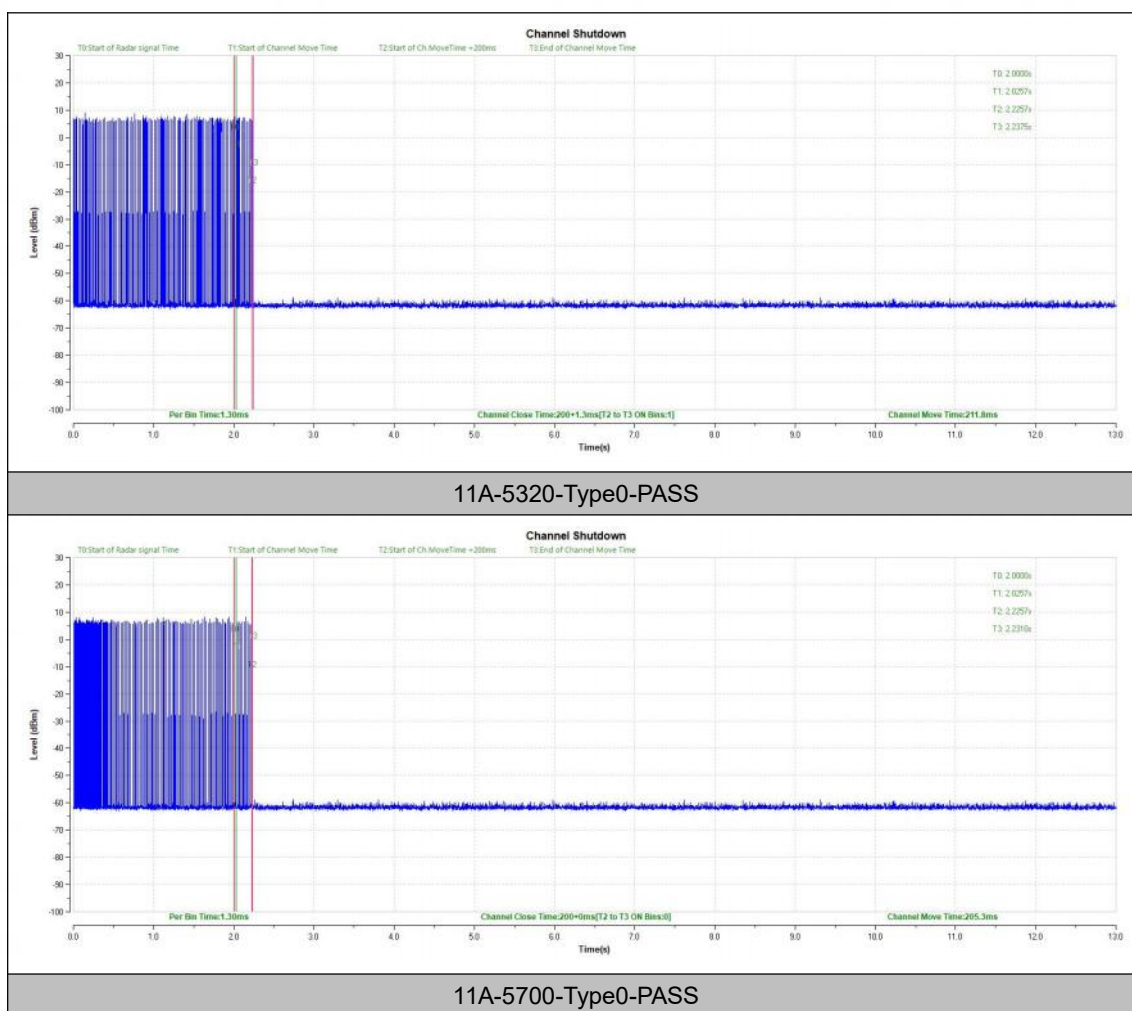

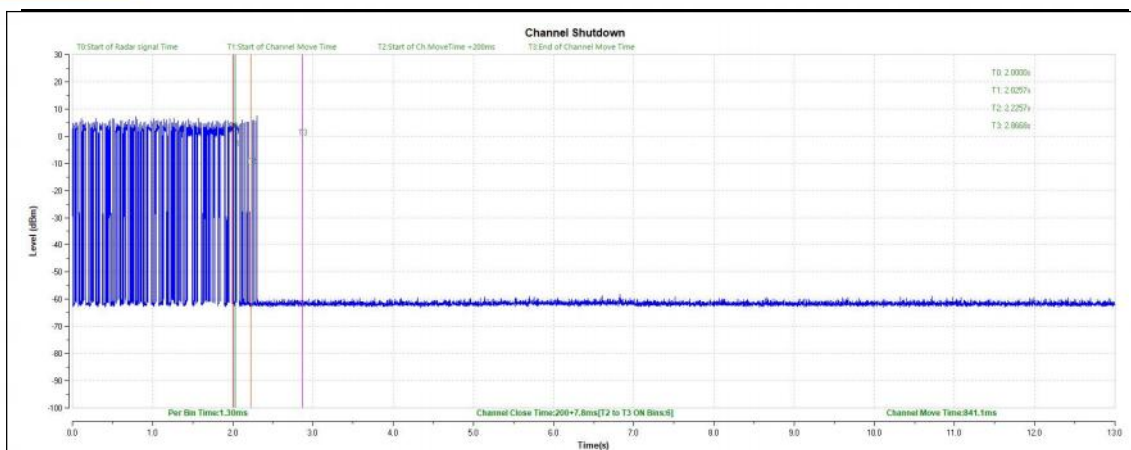

11AX80SISO-5290-Type0-PASS

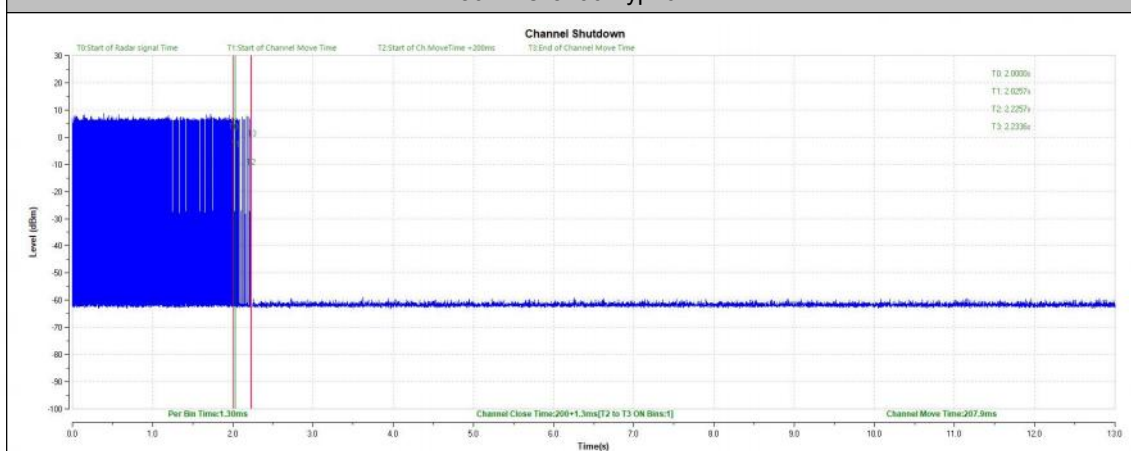


11AX80SISO-5530-Type0-PASS

Appendix H: Non-Occupancy Period

Test Result

TestMode	Frequency[MHz]	Result	Limit[s]	Verdict
11A	5320	see test graph	≥1800	PASS
11A	5700	see test graph	≥1800	PASS
11AX80SISO	5290	see test graph	≥1800	PASS
11AX80SISO	5530	see test graph	≥1800	PASS


Test Graphs

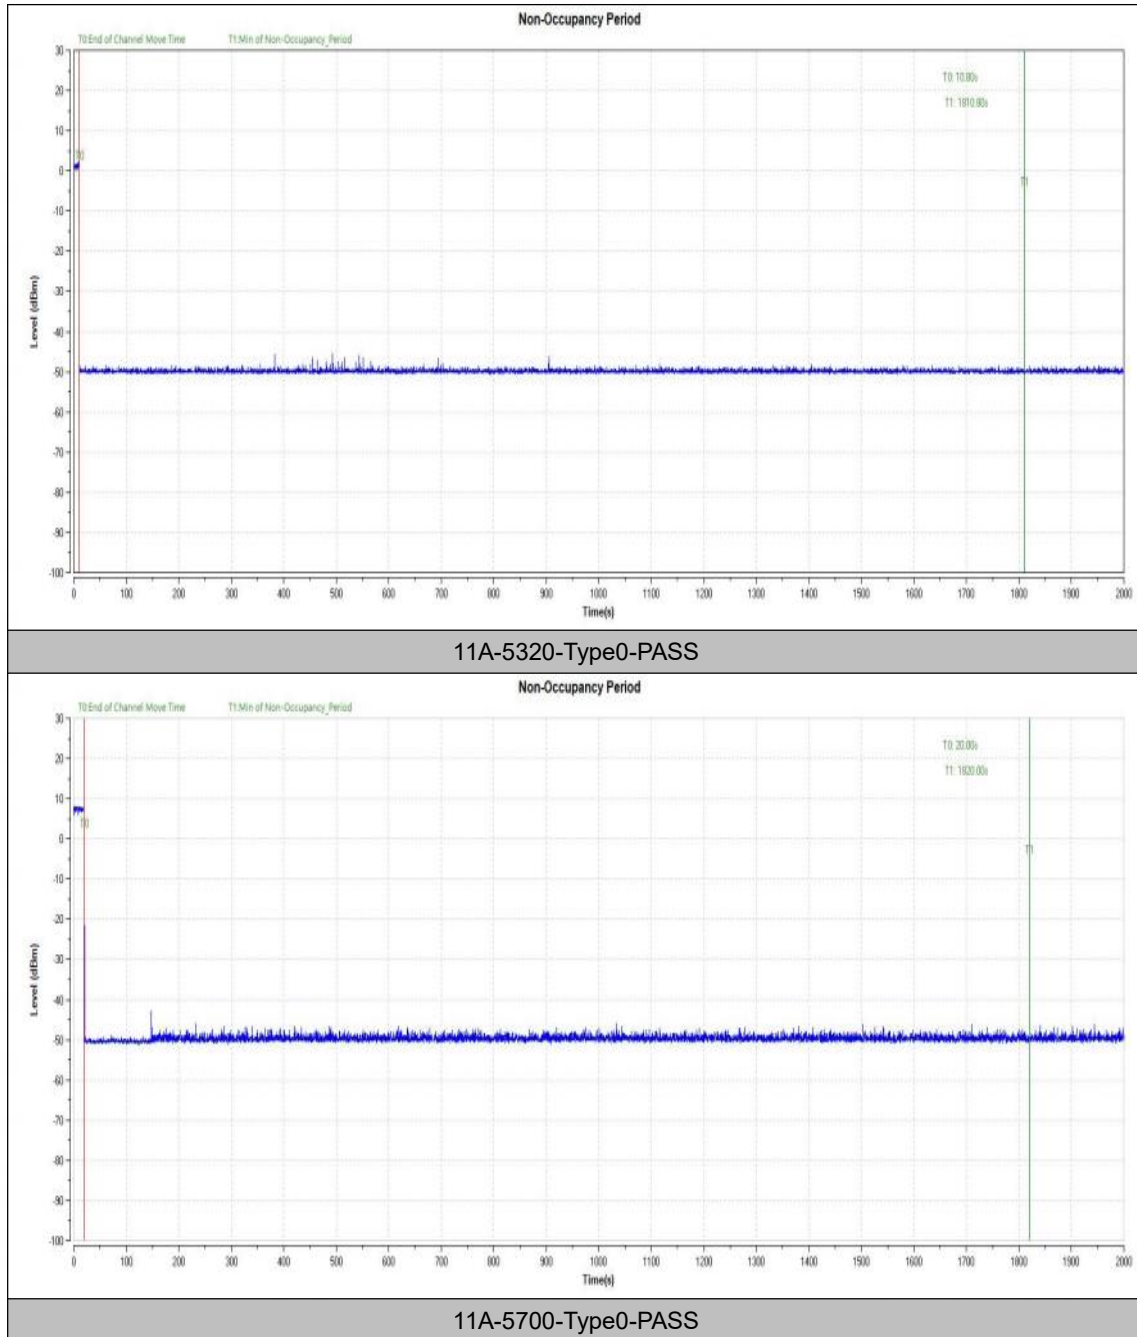

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

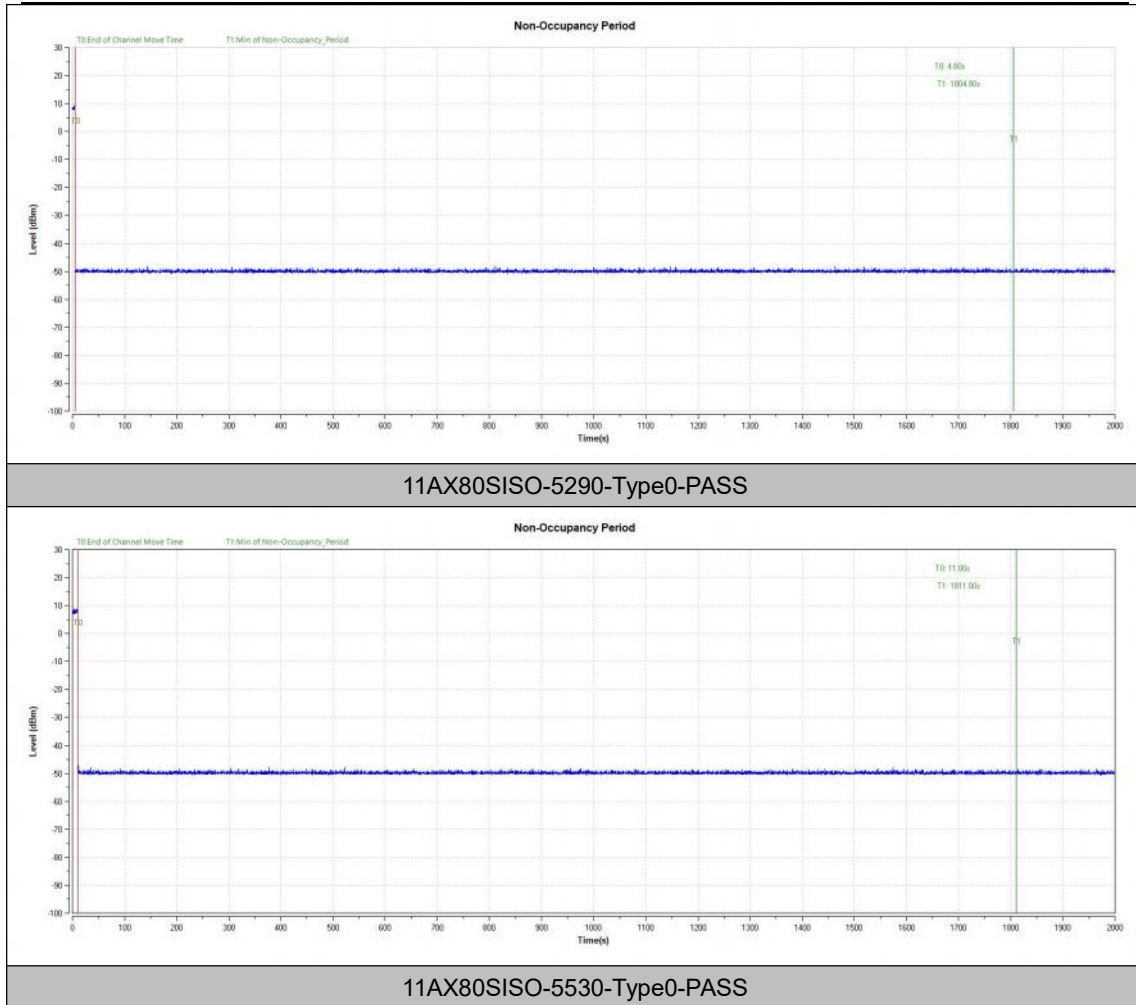

---END---