



Appendix A3: Minimum 6dB Bandwidth


Test Result B4


Test Mode	Antenna	Frequency[MHz]	6db EBW [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5745	16.28	5736.88	5753.16	0.5	PASS
11A	Ant1	5785	16.56	5776.76	5793.32	0.5	PASS
11A	Ant1	5825	16.32	5816.88	5833.20	0.5	PASS
11N20SISO	Ant1	5745	17.76	5736.16	5753.92	0.5	PASS
11N20SISO	Ant1	5785	17.80	5776.12	5793.92	0.5	PASS
11N20SISO	Ant1	5825	17.68	5816.24	5833.92	0.5	PASS
11N40SISO	Ant1	5755	36.08	5736.84	5772.92	0.5	PASS
11N40SISO	Ant1	5795	36.56	5776.76	5813.32	0.5	PASS
11AC20SISO	Ant1	5745	17.76	5736.16	5753.92	0.5	PASS
11AC20SISO	Ant1	5785	17.72	5776.16	5793.88	0.5	PASS
11AC20SISO	Ant1	5825	17.68	5816.20	5833.88	0.5	PASS
11AC40SISO	Ant1	5755	36.48	5736.76	5773.24	0.5	PASS
11AC40SISO	Ant1	5795	36.48	5776.84	5813.32	0.5	PASS
11AC80SISO	Ant1	5775	75.20	5737.72	5812.92	0.5	PASS
11AX20SISO	Ant1	5745	19.16	5735.44	5754.60	0.5	PASS
11AX20SISO	Ant1	5785	19.20	5775.40	5794.60	0.5	PASS
11AX20SISO	Ant1	5825	19.04	5815.52	5834.56	0.5	PASS
11AX40SISO	Ant1	5755	38.16	5735.96	5774.12	0.5	PASS
11AX40SISO	Ant1	5795	38.16	5775.96	5814.12	0.5	PASS
11AX80SISO	Ant1	5775	78.08	5736.12	5814.20	0.5	PASS

Test Graphs B4

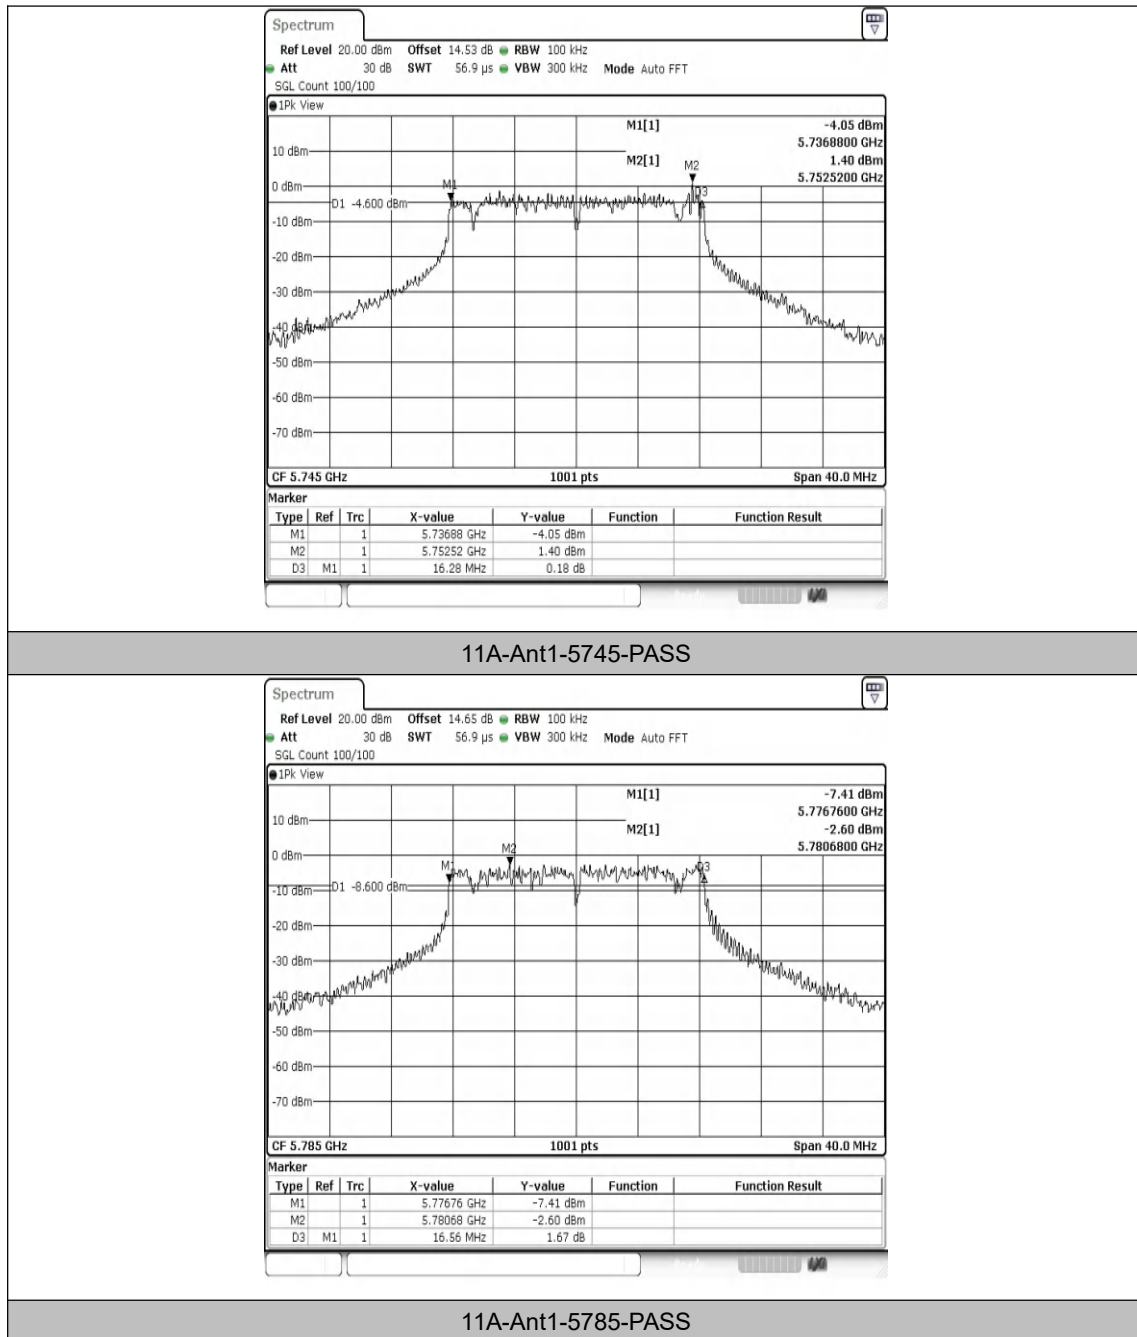


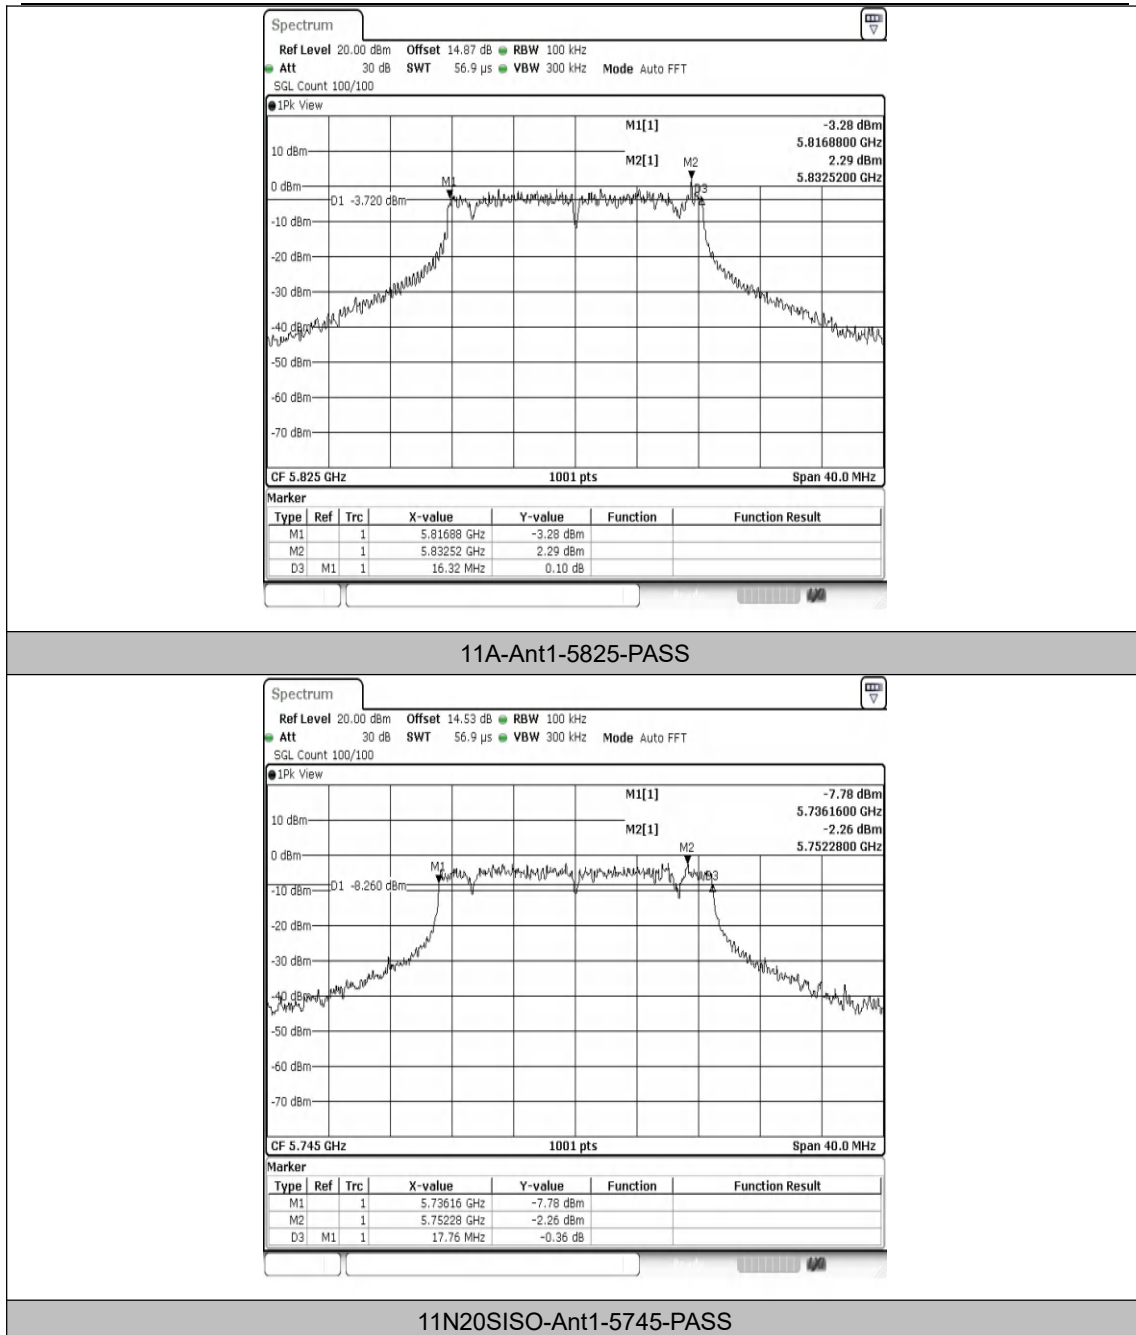

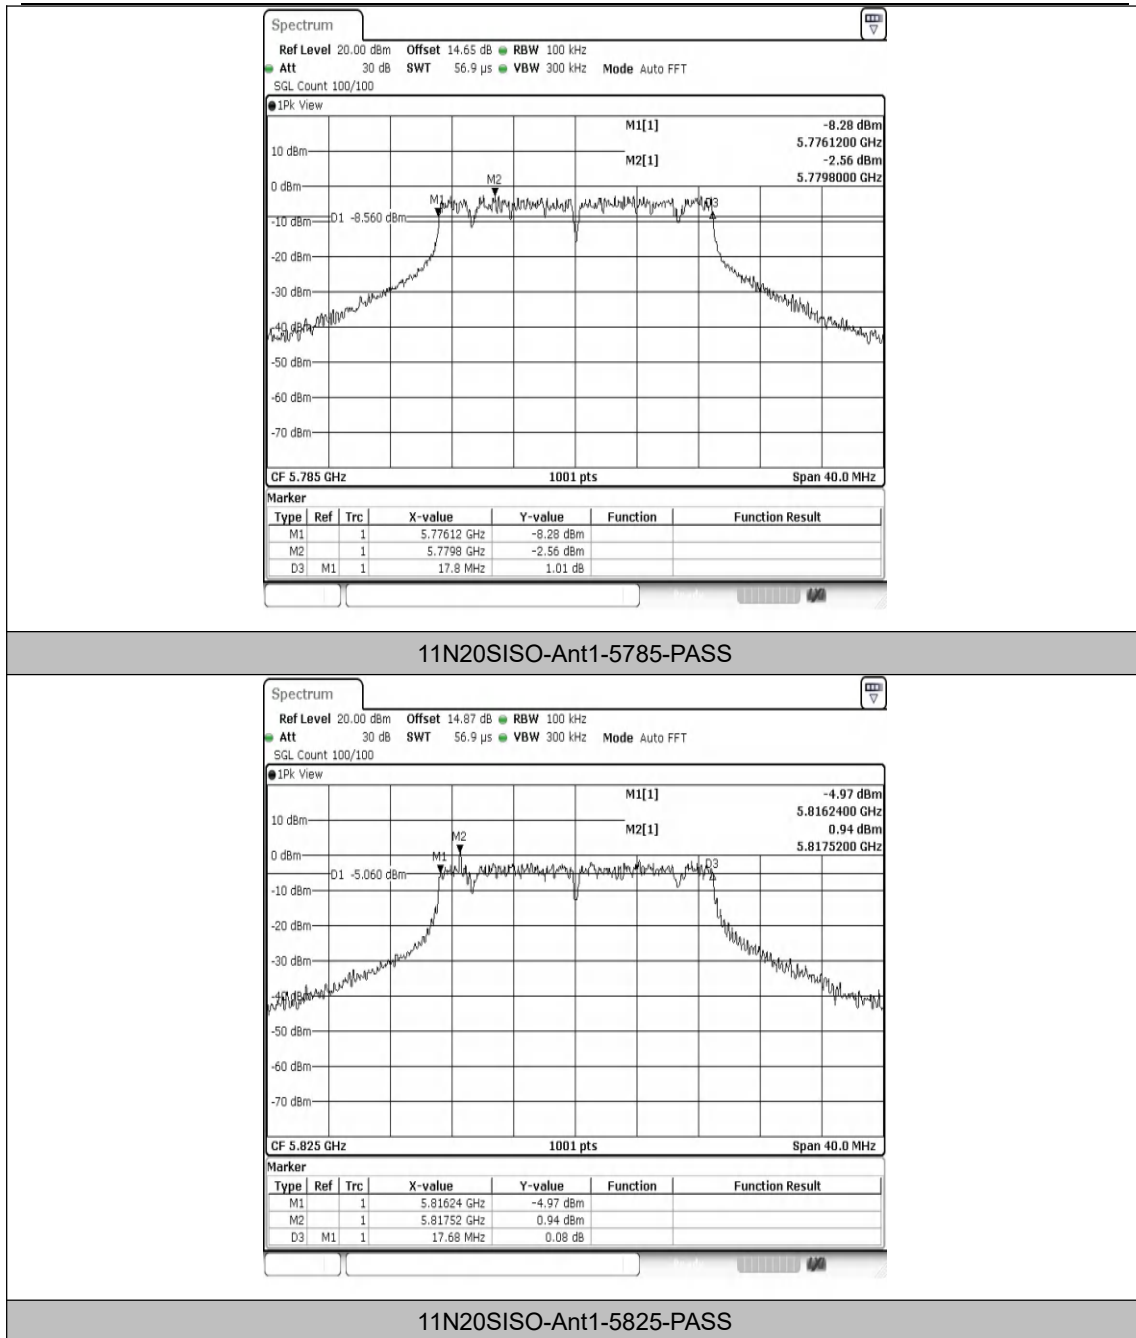


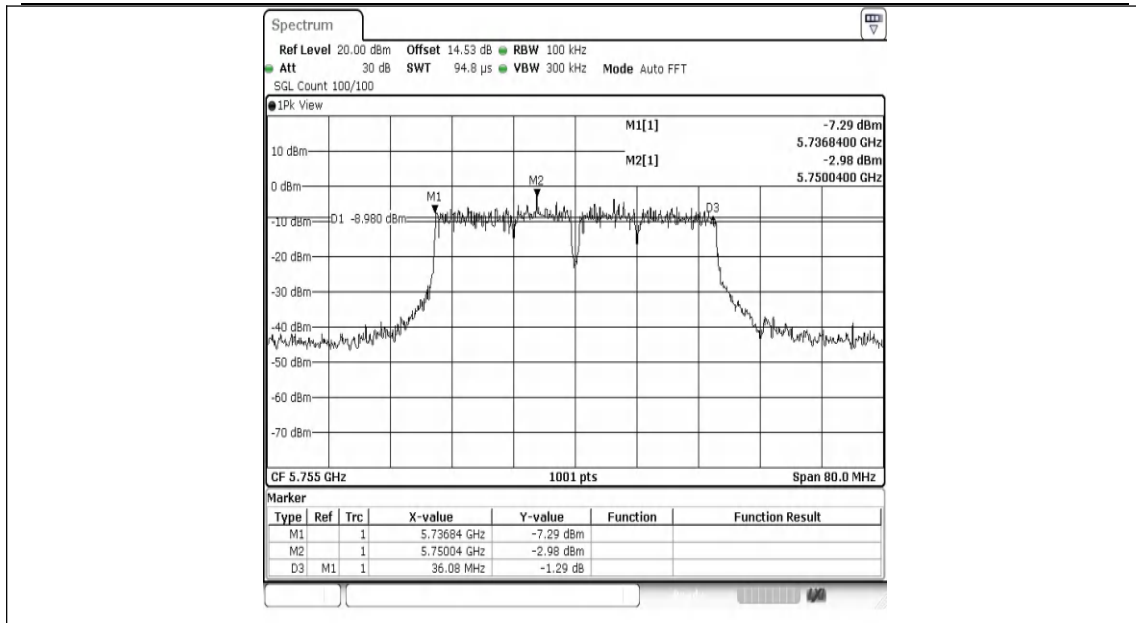


11N40SISO-Ant1-5755-PASS

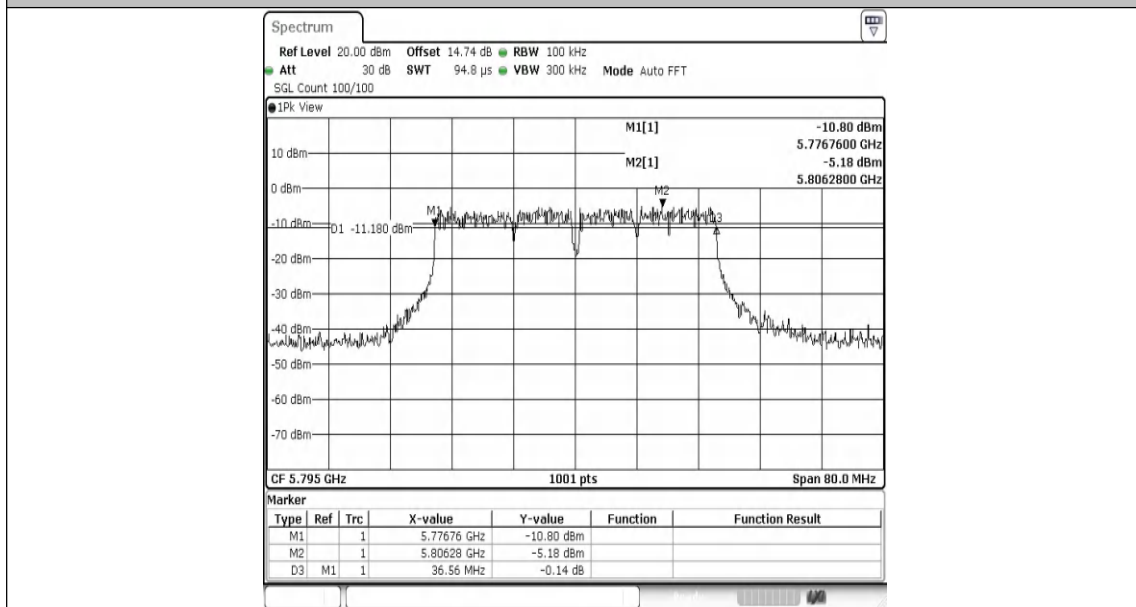


11N40SISO-Ant1-5795-PASS

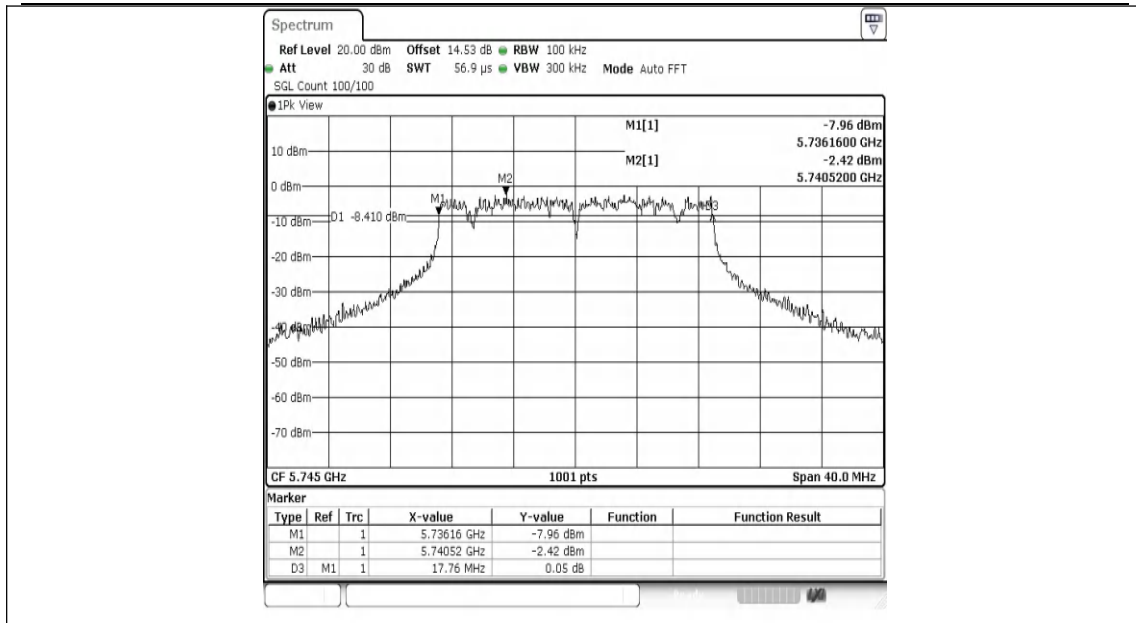


11AC20SISO-Ant1-5745-PASS

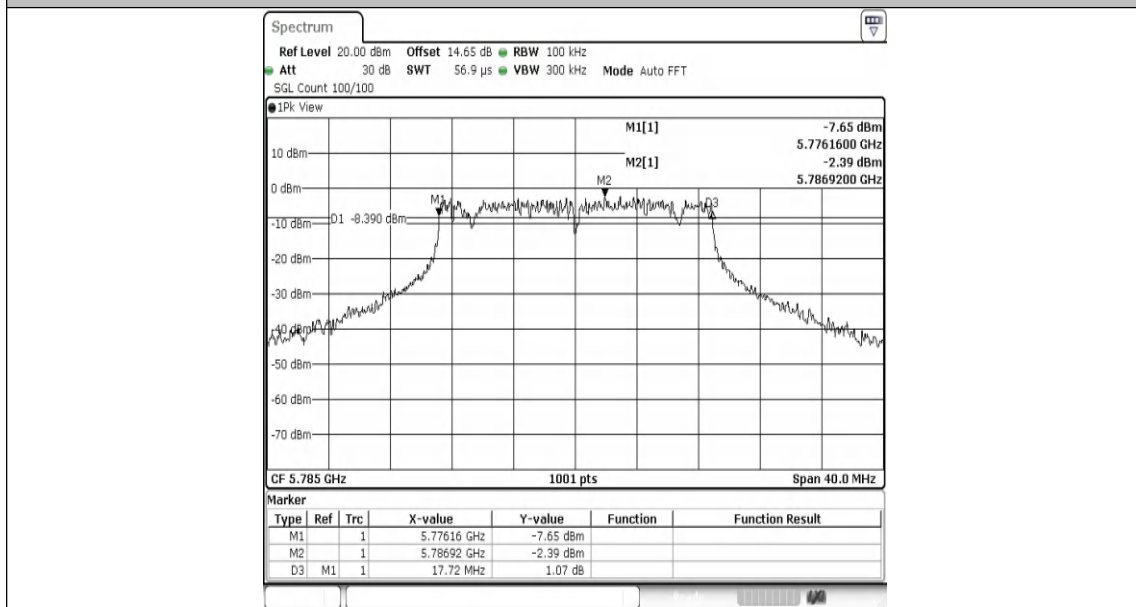


11AC20SISO-Ant1-5785-PASS

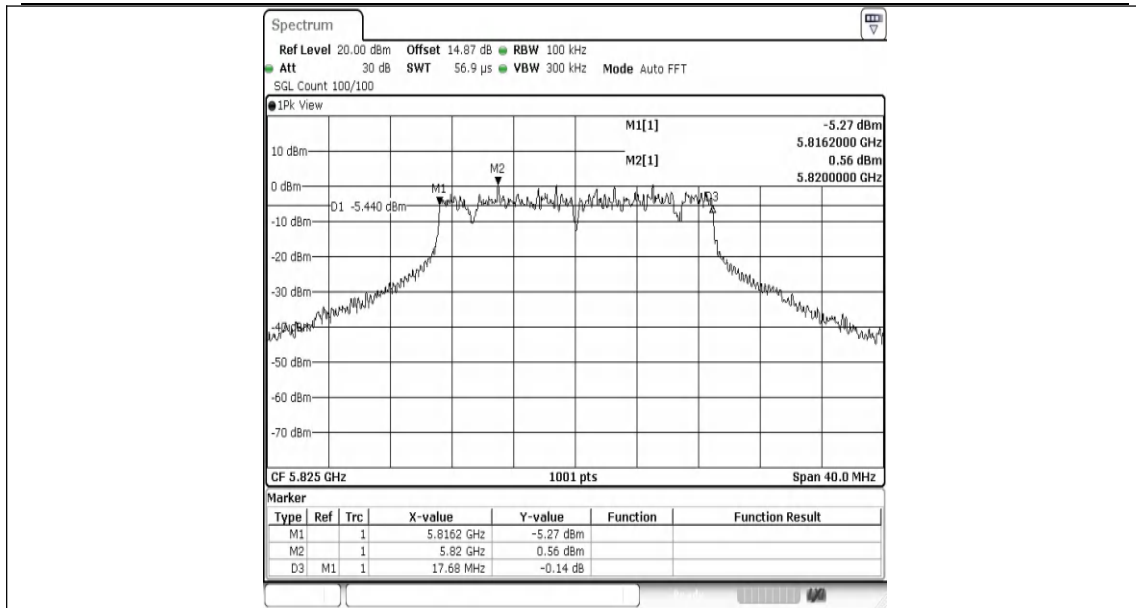


11AC20SISO-Ant1-5825-PASS

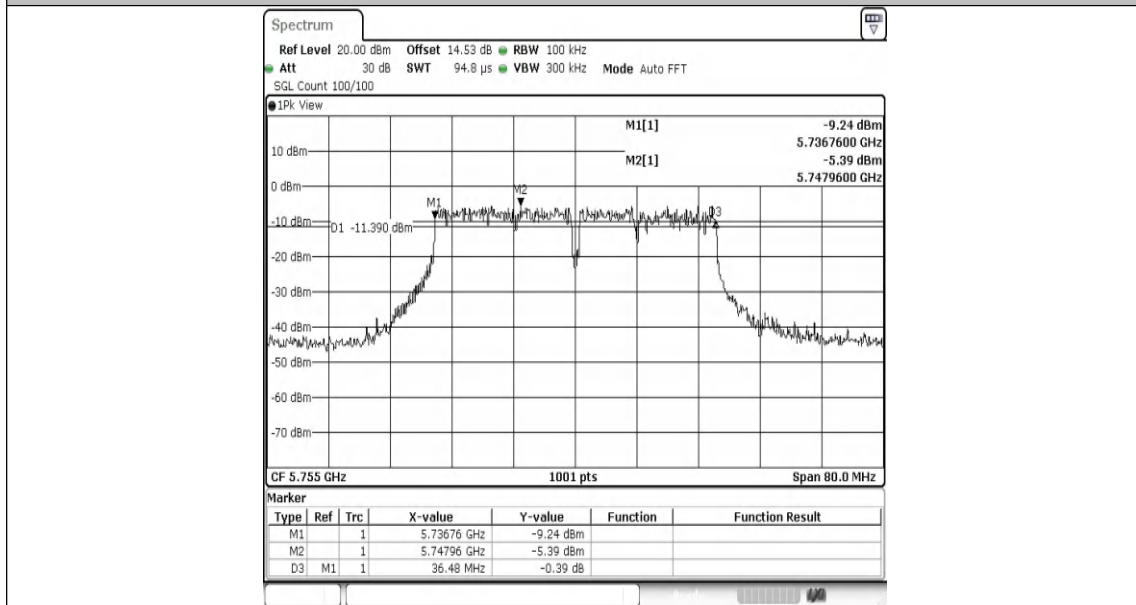


11AC40SISO-Ant1-5755-PASS

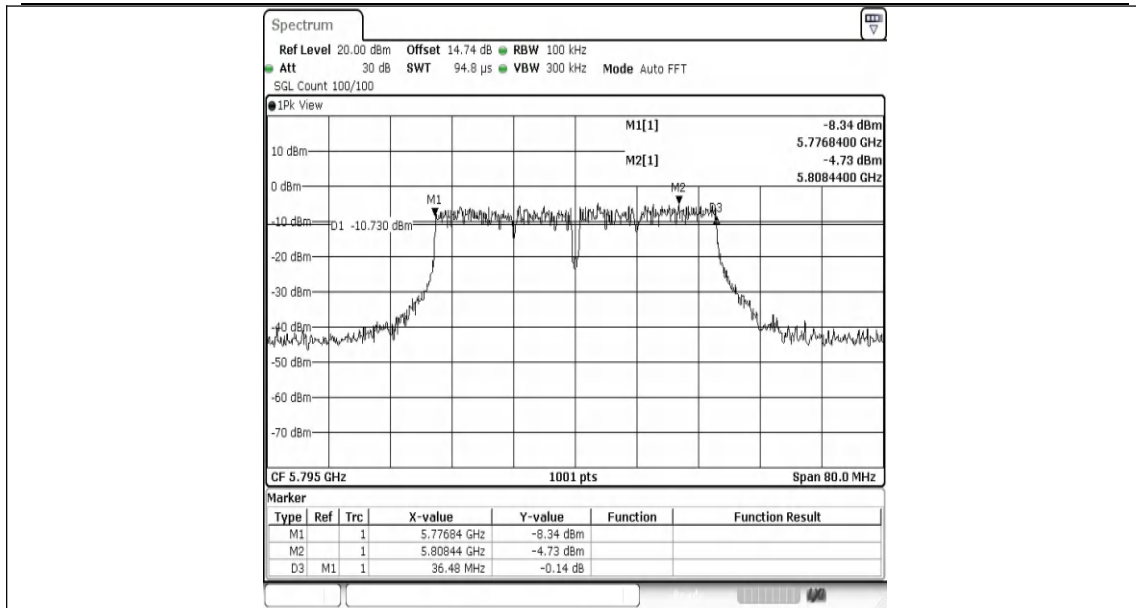


11AC40SISO-Ant1-5795-PASS

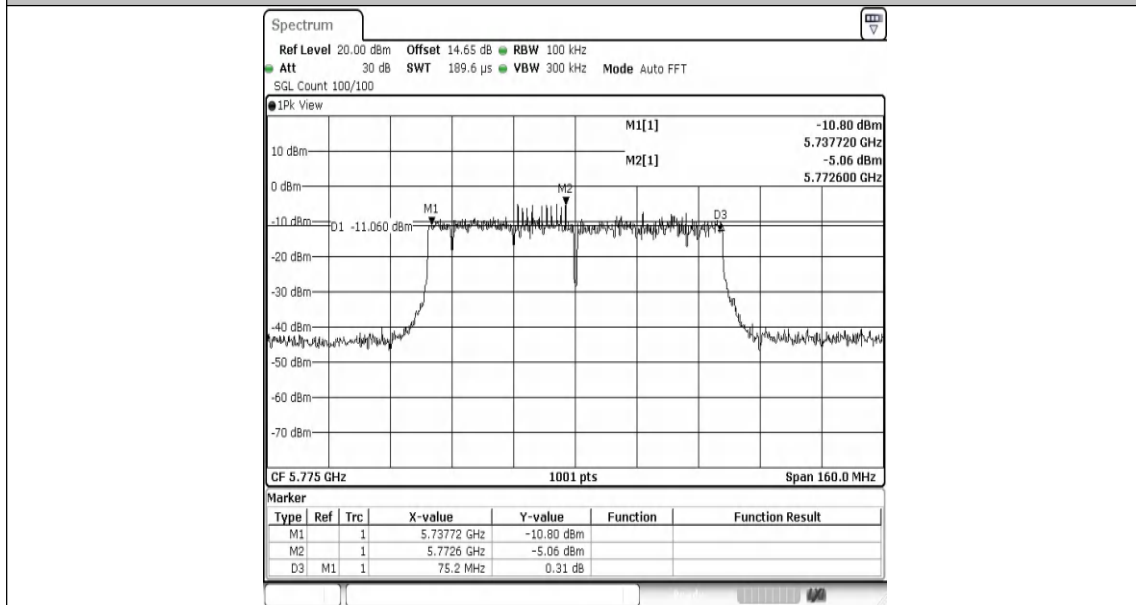


11AC80SISO-Ant1-5775-PASS

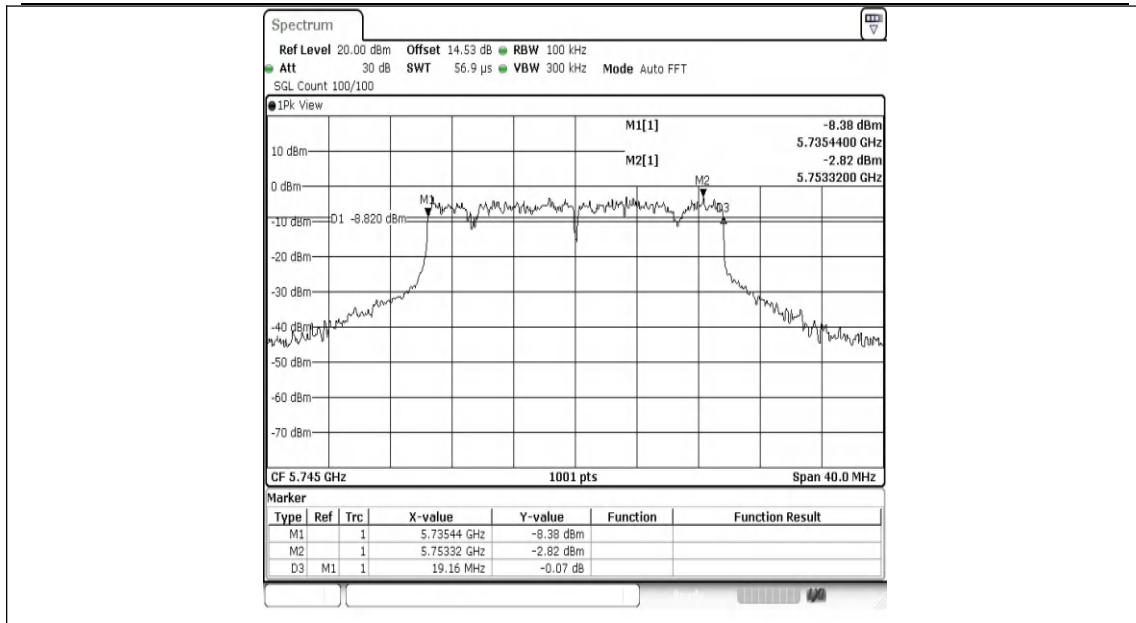


11AX20SISO-Ant1-5745-PASS

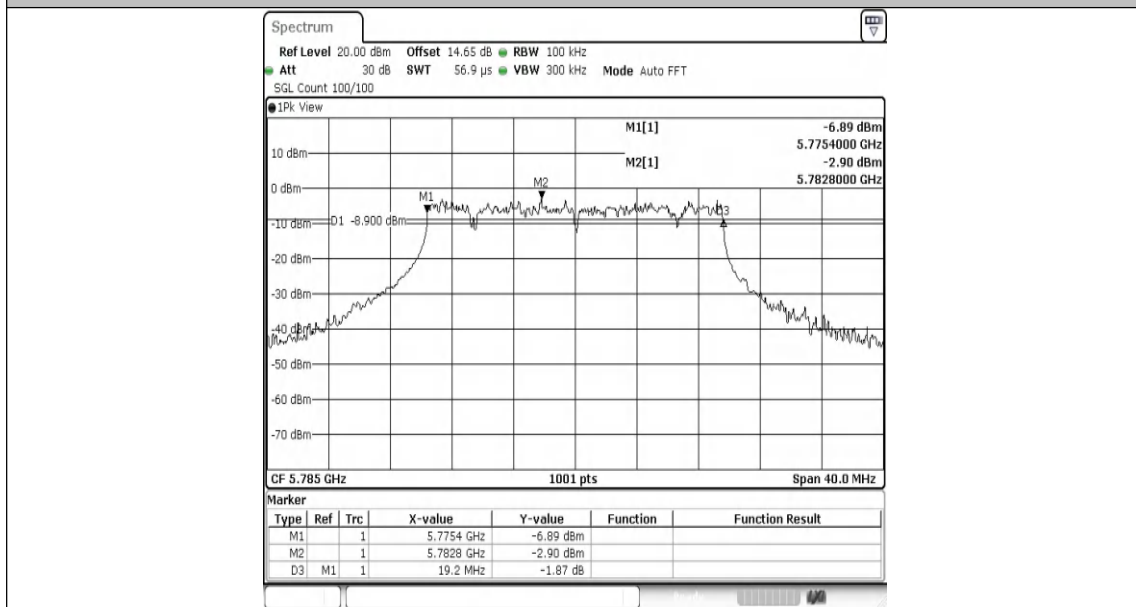


11AX20SISO-Ant1-5785-PASS

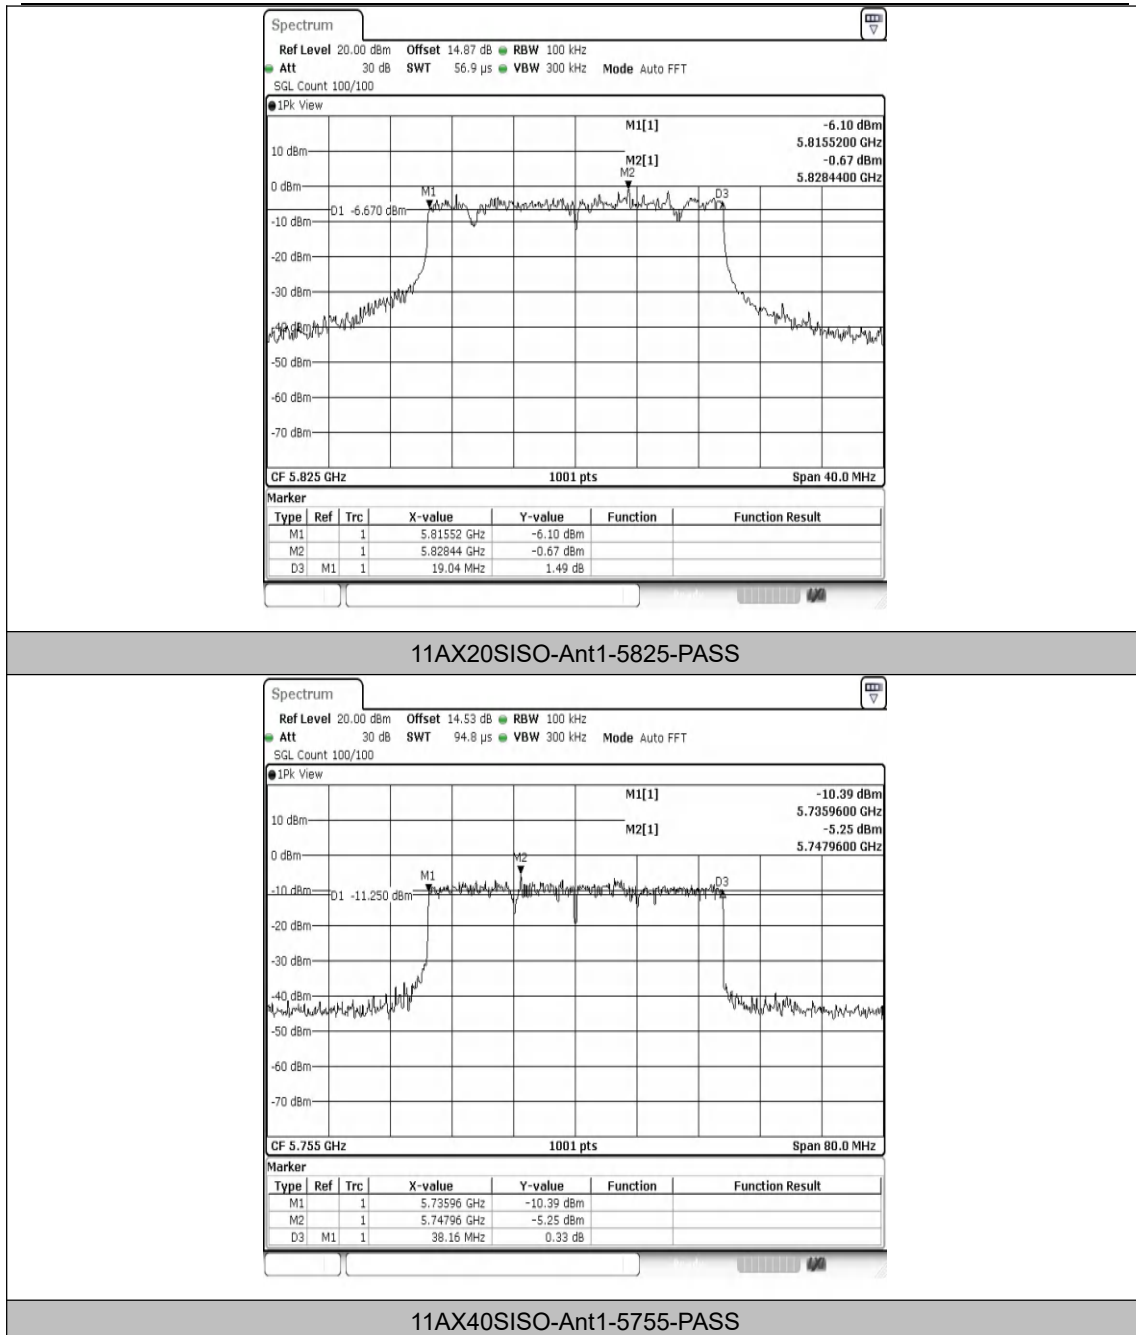

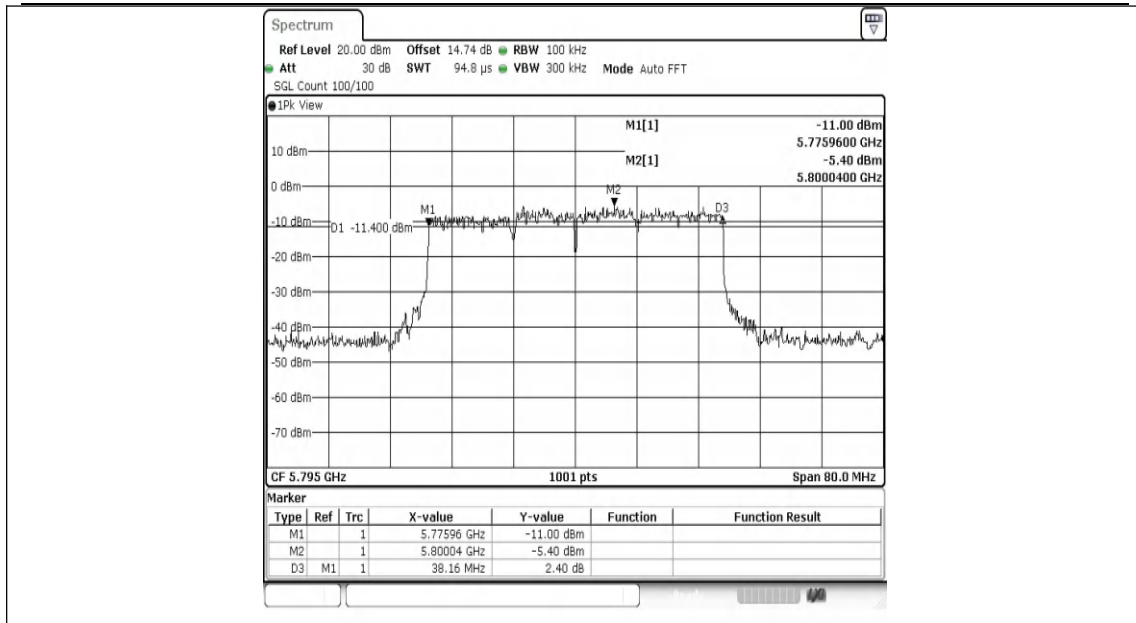

11AX40SISO-Ant1-5795-PASS

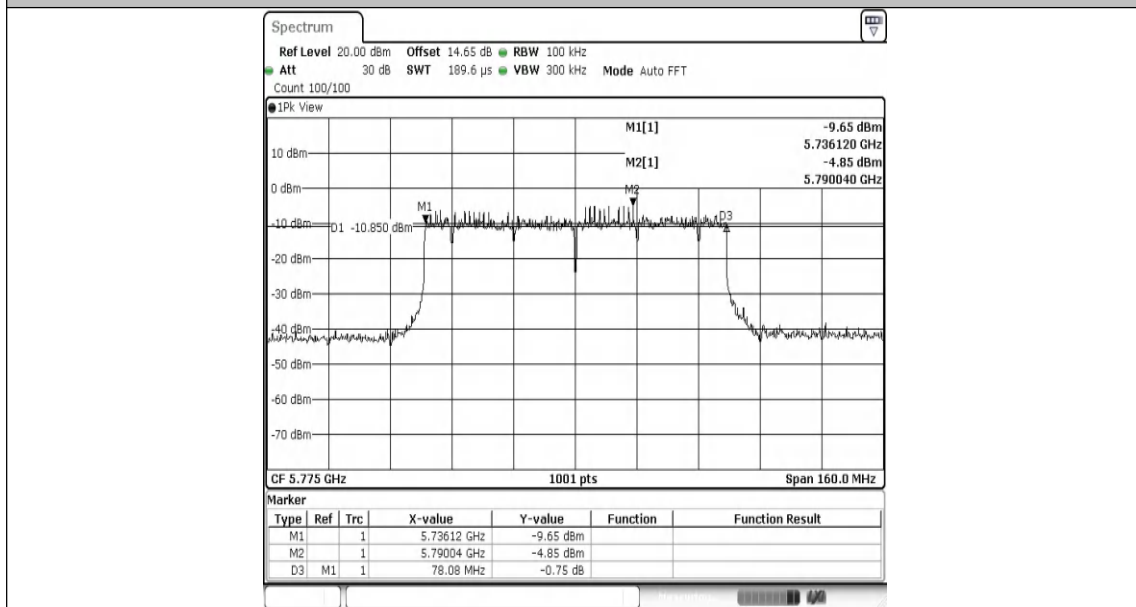

11AX80SISO-Ant1-5775-PASS

Appendix B: Duty Cycle

Test Result

Test Mode	Antenna	Frequency [MHz]	Transmission Duration [ms]	Transmission Period [ms]	Duty Cycle [%]	Dc Factor [dB]	1/T
11A	Ant1	5180	2.00	2.25	88.89	0.51	0.50
11A	Ant1	5200	2.00	2.25	88.89	0.51	0.50
11A	Ant1	5240	2.00	2.25	88.89	0.51	0.50
11A	Ant1	5260	2.00	2.25	88.89	0.51	0.50
11A	Ant1	5280	2.00	2.25	88.89	0.51	0.50
11A	Ant1	5320	2.00	2.25	88.89	0.51	0.50
11A	Ant1	5500	2.00	2.25	88.89	0.51	0.50
11A	Ant1	5580	2.00	2.25	88.89	0.51	0.50
11A	Ant1	5700	2.00	2.25	88.89	0.51	0.50
11A	Ant1	5745	2.00	2.25	88.89	0.51	0.50
11A	Ant1	5785	2.00	2.25	88.89	0.51	0.50
11A	Ant1	5825	2.00	2.25	88.89	0.51	0.50
11N20SISO	Ant1	5180	1.85	2.05	90.24	0.45	0.54
11N20SISO	Ant1	5200	1.85	2.10	88.10	0.55	0.54
11N20SISO	Ant1	5240	1.85	2.10	88.10	0.55	0.54
11N20SISO	Ant1	5260	1.90	2.15	88.37	0.54	0.53
11N20SISO	Ant1	5280	1.90	2.15	88.37	0.54	0.53
11N20SISO	Ant1	5320	1.90	2.10	90.48	0.43	0.53
11N20SISO	Ant1	5500	1.85	2.10	88.10	0.55	0.54
11N20SISO	Ant1	5580	1.90	2.15	88.37	0.54	0.53
11N20SISO	Ant1	5700	1.90	2.45	77.55	1.10	0.53
11N20SISO	Ant1	5745	1.90	2.15	88.37	0.54	0.53
11N20SISO	Ant1	5785	1.90	2.35	80.85	0.92	0.53
11N20SISO	Ant1	5825	1.90	2.45	77.55	1.10	0.53
11N40SISO	Ant1	5190	0.92	1.10	83.64	0.78	1.09
11N40SISO	Ant1	5230	0.94	1.12	83.93	0.76	1.06
11N40SISO	Ant1	5270	0.94	1.12	83.93	0.76	1.06
11N40SISO	Ant1	5310	0.92	1.10	83.64	0.78	1.09
11N40SISO	Ant1	5510	0.94	1.18	79.66	0.99	1.06
11N40SISO	Ant1	5550	0.94	1.10	85.45	0.68	1.06
11N40SISO	Ant1	5670	0.92	1.16	79.31	1.01	1.09
11N40SISO	Ant1	5755	0.94	1.16	81.03	0.91	1.06
11N40SISO	Ant1	5795	0.94	1.40	67.14	1.73	1.06
11AC20SISO	Ant1	5180	1.90	2.06	92.23	0.35	0.53
11AC20SISO	Ant1	5200	1.90	2.08	91.35	0.39	0.53
11AC20SISO	Ant1	5240	1.92	2.12	90.57	0.43	0.52

11AC20SISO	Ant1	5260	1.90	2.12	89.62	0.48	0.53
11AC20SISO	Ant1	5280	1.90	2.12	89.62	0.48	0.53
11AC20SISO	Ant1	5320	1.90	2.14	88.79	0.52	0.53
11AC20SISO	Ant1	5500	1.90	2.14	88.79	0.52	0.53
11AC20SISO	Ant1	5580	1.90	2.18	87.16	0.60	0.53
11AC20SISO	Ant1	5700	1.90	2.14	88.79	0.52	0.53
11AC20SISO	Ant1	5745	1.90	2.18	87.16	0.60	0.53
11AC20SISO	Ant1	5785	1.90	2.26	84.07	0.75	0.53
11AC20SISO	Ant1	5825	1.90	2.12	89.62	0.48	0.53
11AC40SISO	Ant1	5190	0.94	1.26	74.60	1.27	1.06
11AC40SISO	Ant1	5230	0.94	1.12	83.93	0.76	1.06
11AC40SISO	Ant1	5270	0.94	1.18	79.66	0.99	1.06
11AC40SISO	Ant1	5310	0.92	1.10	83.64	0.78	1.09
11AC40SISO	Ant1	5510	0.94	1.18	79.66	0.99	1.06
11AC40SISO	Ant1	5550	0.92	1.10	83.64	0.78	1.09
11AC40SISO	Ant1	5670	0.92	1.16	79.31	1.01	1.09
11AC40SISO	Ant1	5755	0.94	1.12	83.93	0.76	1.06
11AC40SISO	Ant1	5795	0.94	1.20	78.33	1.06	1.06
11AC80SISO	Ant1	5210	0.44	0.68	64.71	1.89	2.27
11AC80SISO	Ant1	5290	0.46	0.64	71.88	1.43	2.17
11AC80SISO	Ant1	5530	0.44	0.92	47.83	3.20	2.27
11AC80SISO	Ant1	5775	0.46	0.74	62.16	2.06	2.17
11AX20SISO	Ant1	5180	1.46	1.82	80.22	0.96	0.68
11AX20SISO	Ant1	5200	1.46	1.64	89.02	0.51	0.68
11AX20SISO	Ant1	5240	1.46	1.62	90.12	0.45	0.68
11AX20SISO	Ant1	5260	1.46	1.70	85.88	0.66	0.68
11AX20SISO	Ant1	5280	1.46	1.68	86.90	0.61	0.68
11AX20SISO	Ant1	5320	1.46	3.66	39.89	3.99	0.68
11AX20SISO	Ant1	5500	1.46	1.64	89.02	0.51	0.68
11AX20SISO	Ant1	5580	1.46	1.64	89.02	0.51	0.68
11AX20SISO	Ant1	5700	1.46	1.68	86.90	0.61	0.68
11AX20SISO	Ant1	5745	1.46	1.70	85.88	0.66	0.68
11AX20SISO	Ant1	5785	1.46	1.74	83.91	0.76	0.68
11AX20SISO	Ant1	5825	1.46	1.64	89.02	0.51	0.68
11AX40SISO	Ant1	5190	0.76	0.94	80.85	0.92	1.32
11AX40SISO	Ant1	5230	0.76	0.94	80.85	0.92	1.32
11AX40SISO	Ant1	5270	0.76	0.92	82.61	0.83	1.32
11AX40SISO	Ant1	5310	0.76	0.92	82.61	0.83	1.32
11AX40SISO	Ant1	5510	0.76	1.00	76.00	1.19	1.32
11AX40SISO	Ant1	5550	0.76	0.96	79.17	1.01	1.32
11AX40SISO	Ant1	5670	0.76	1.00	76.00	1.19	1.32
11AX40SISO	Ant1	5755	0.76	1.00	76.00	1.19	1.32

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotech.com

 **Hotline**
400-003-0500
www.anbotech.com

11AX40SISO	Ant1	5795	0.76	1.00	76.00	1.19	1.32
11AX80SISO	Ant1	5210	0.38	0.88	43.18	3.65	2.63
11AX80SISO	Ant1	5290	0.38	0.60	63.33	1.98	2.63
11AX80SISO	Ant1	5530	0.38	0.86	44.19	3.55	2.63
11AX80SISO	Ant1	5775	0.38	0.56	67.86	1.68	2.63


Shenzhen Anbotek Compliance Laboratory Limited


Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com





Hotline
400-003-0500
www.anbotek.com


Test Graphs

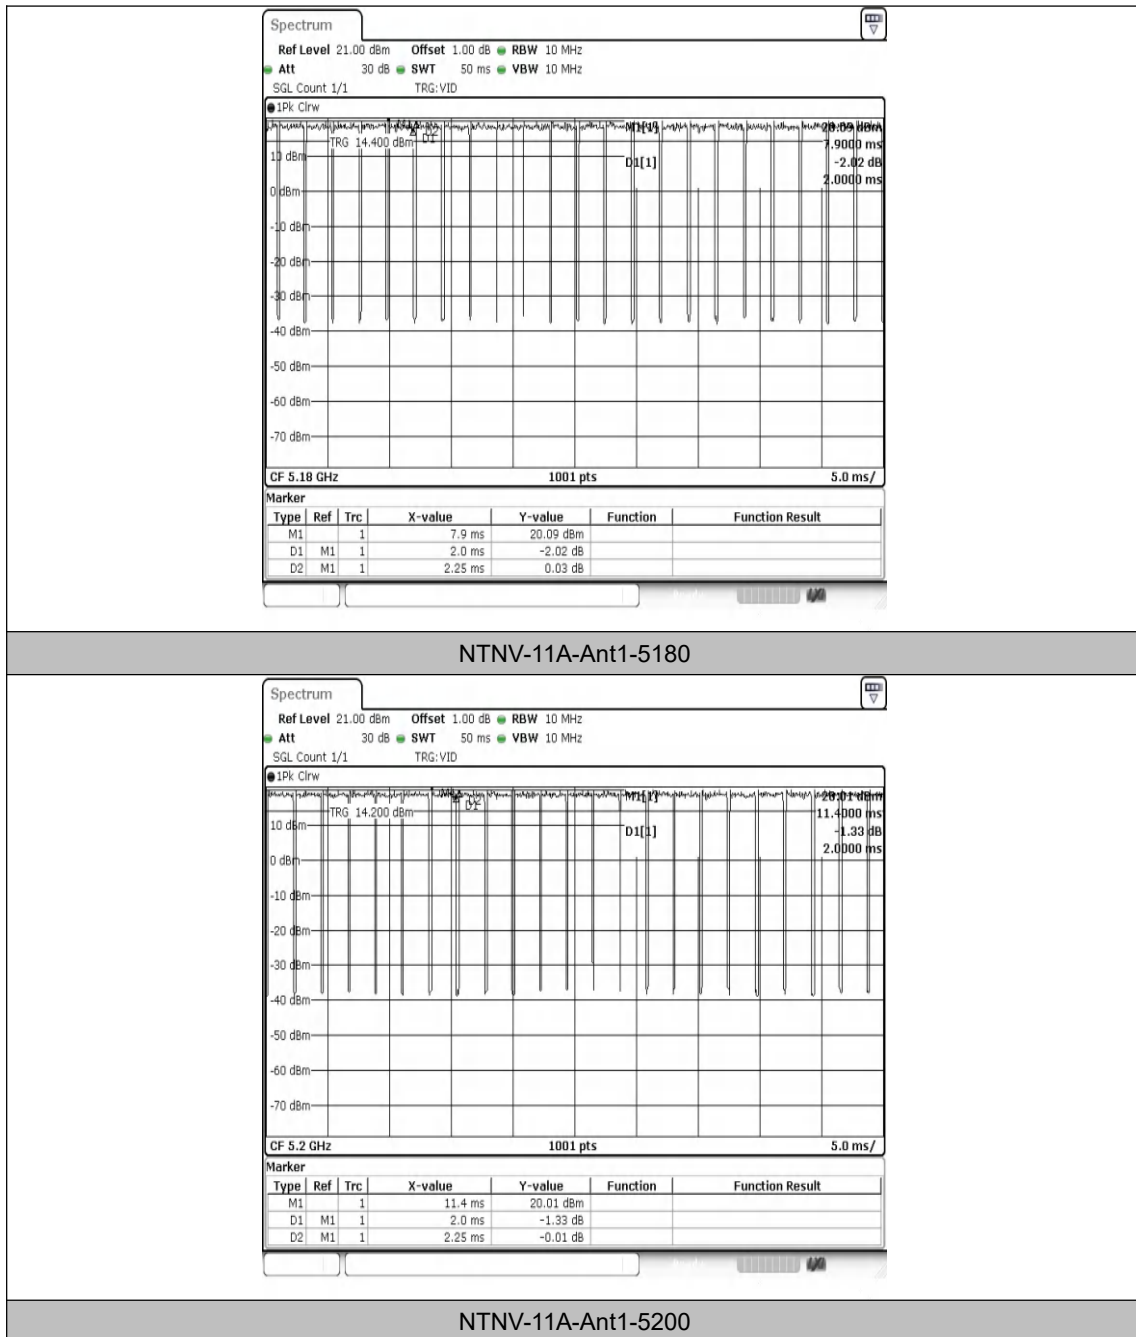


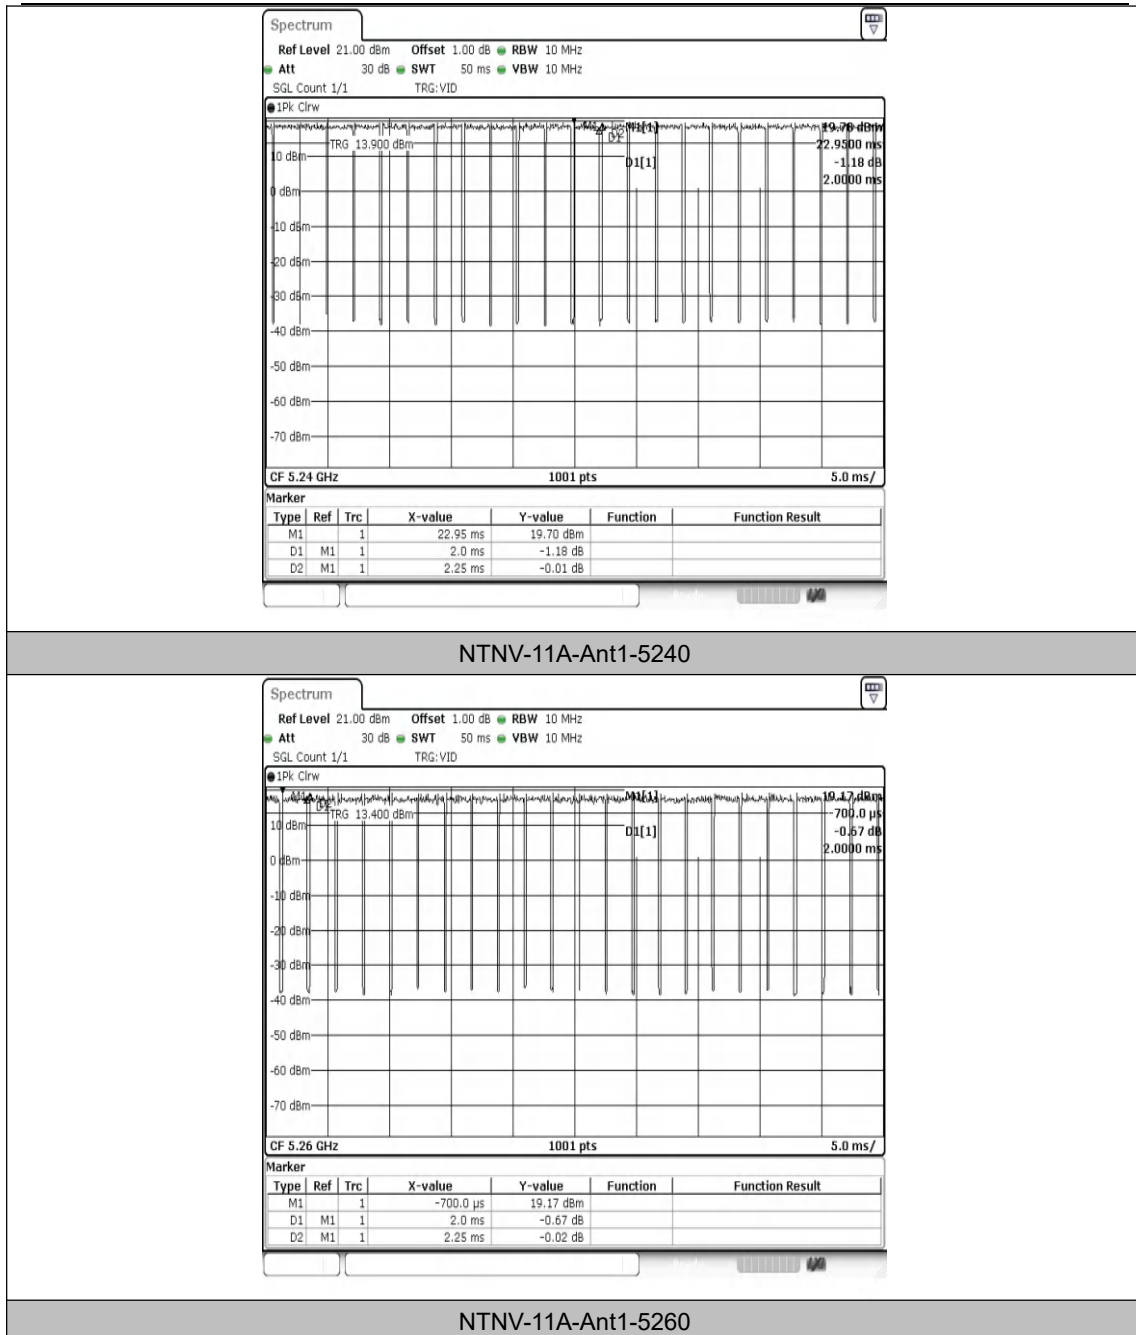


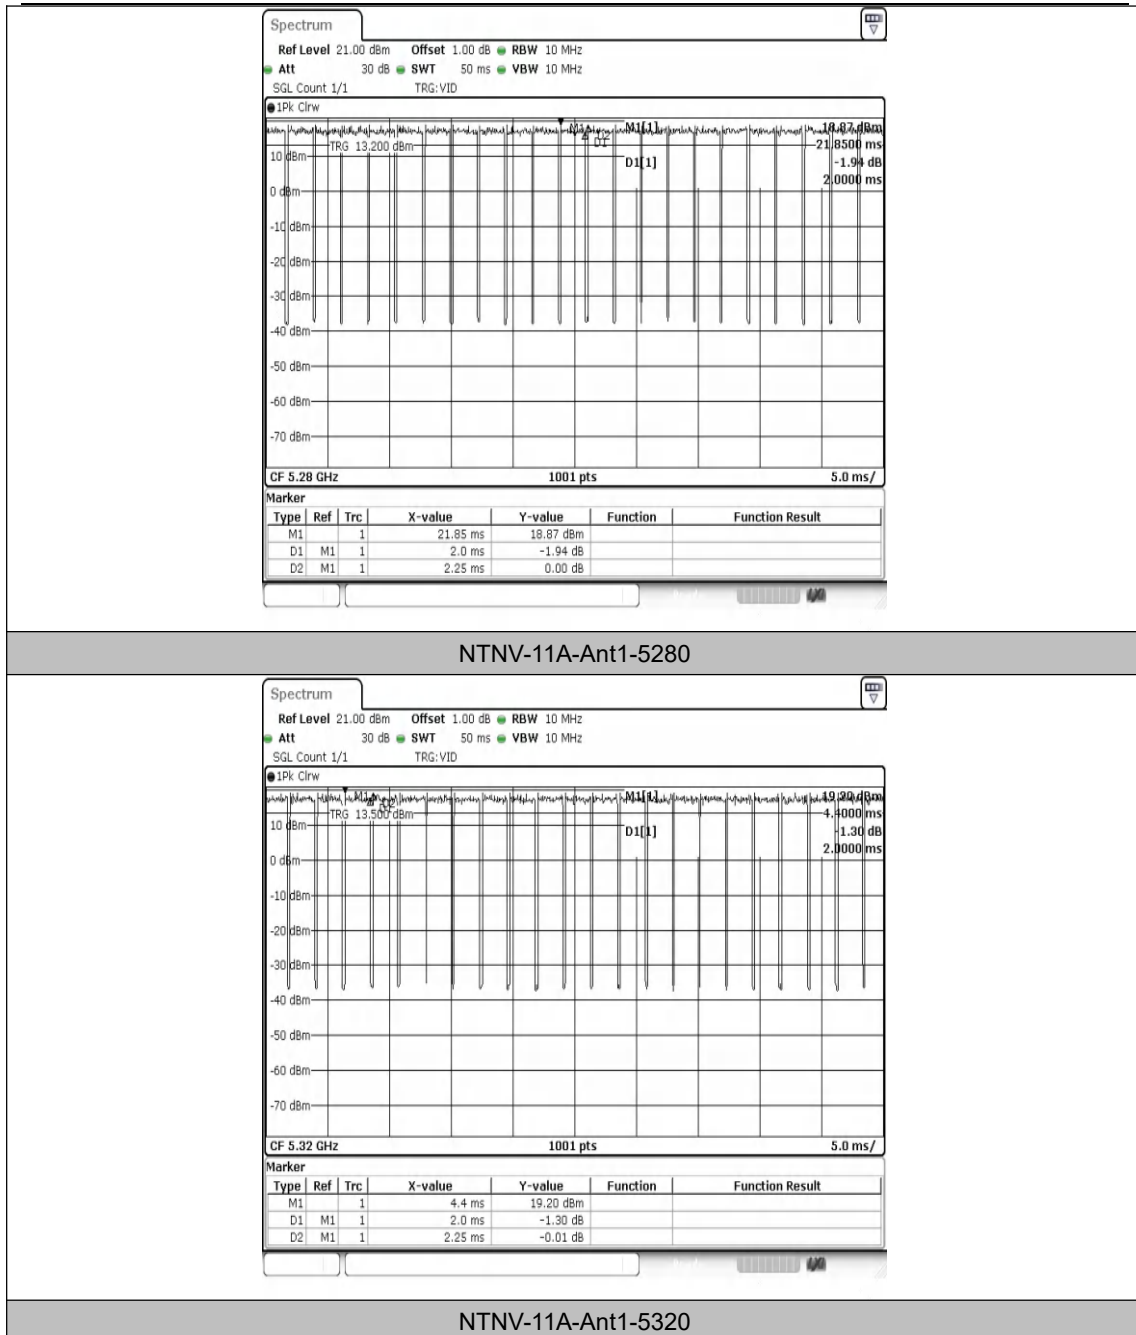


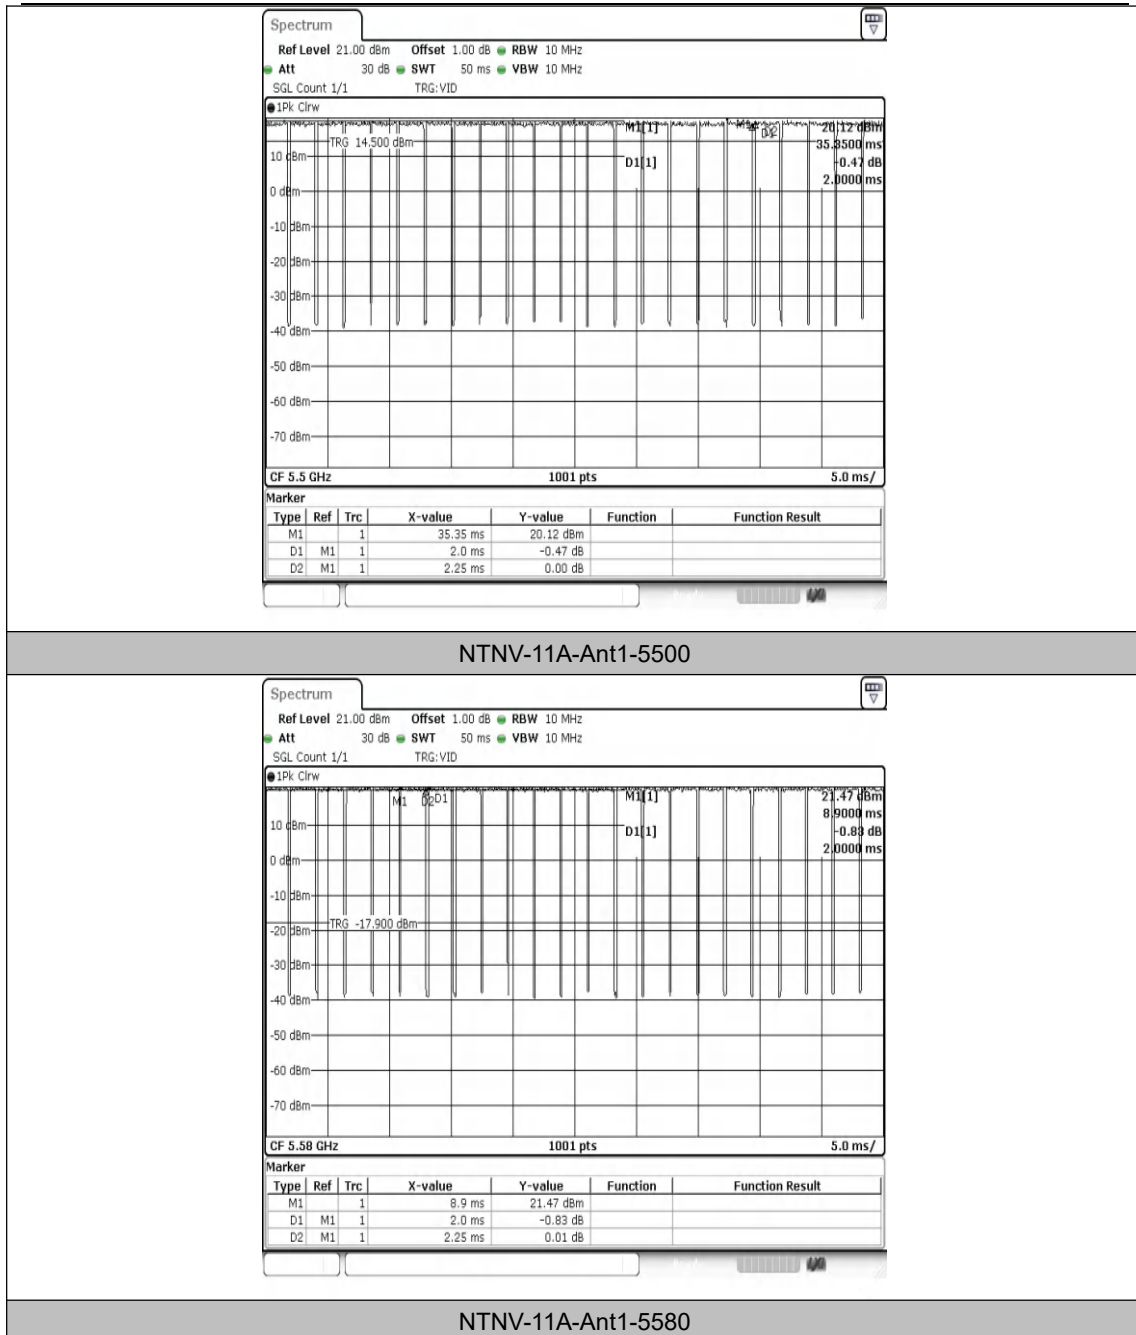


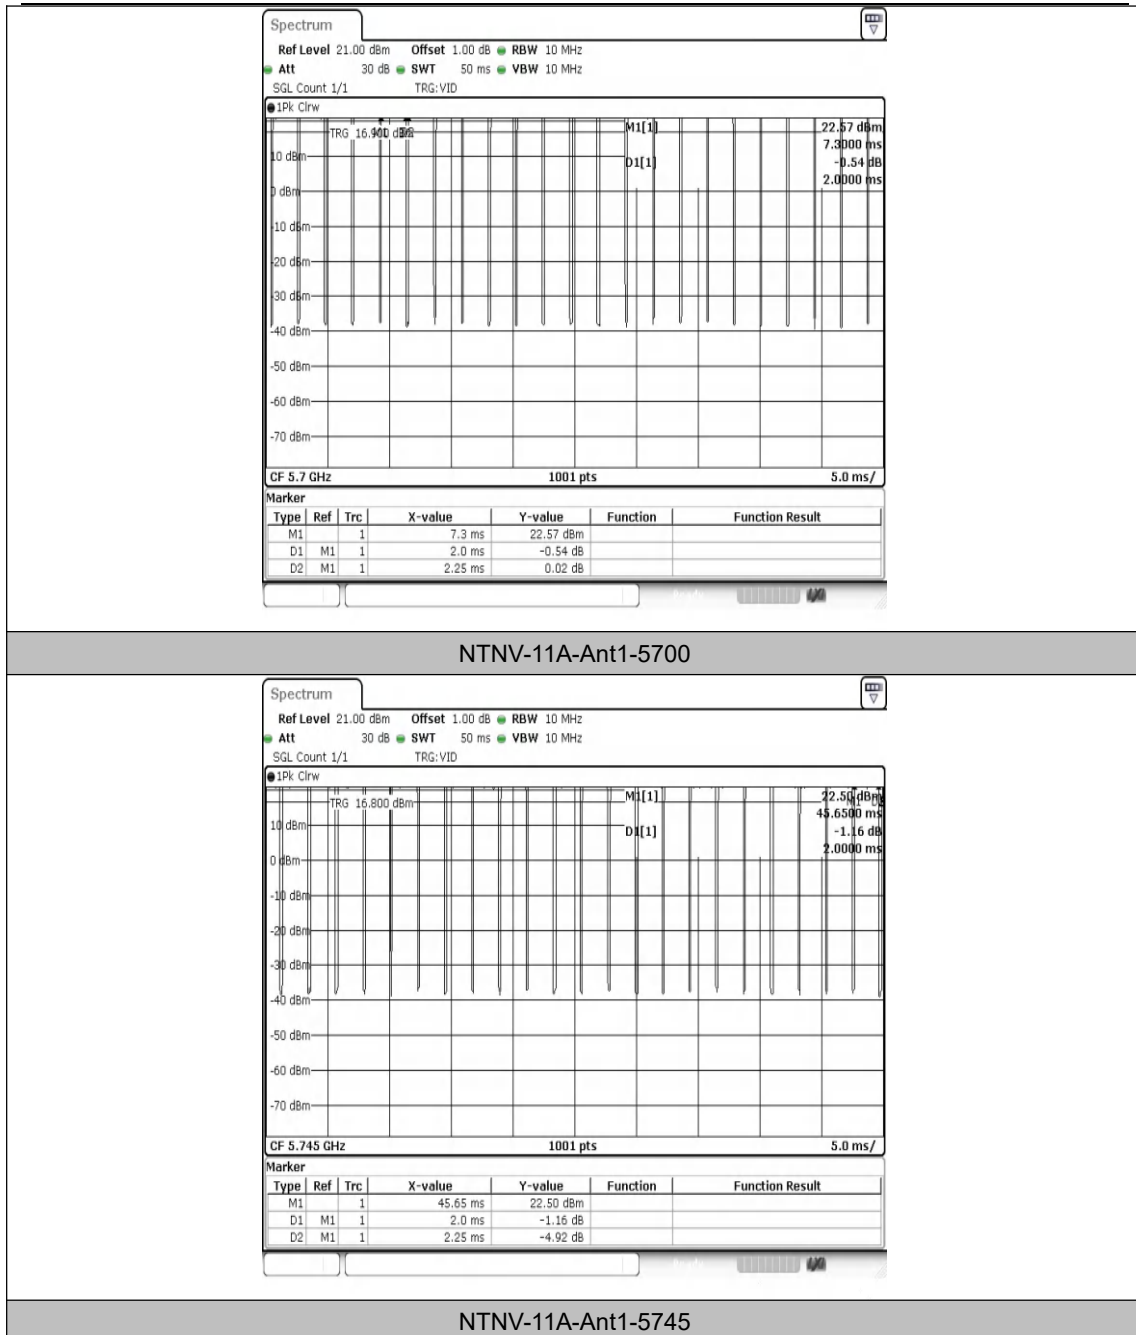


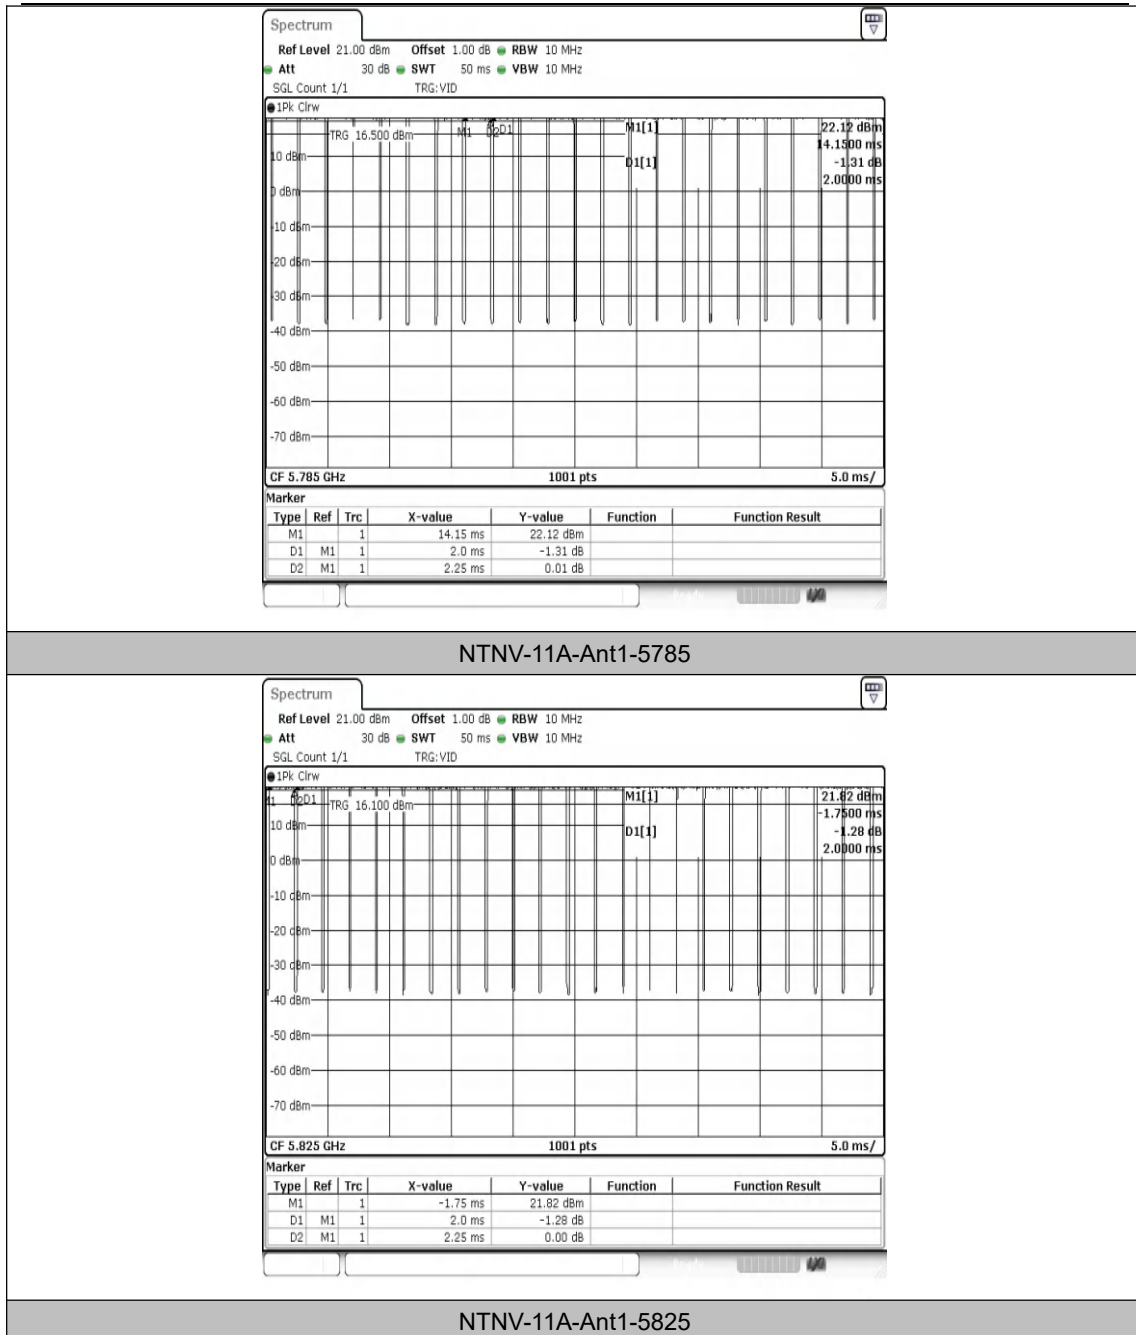


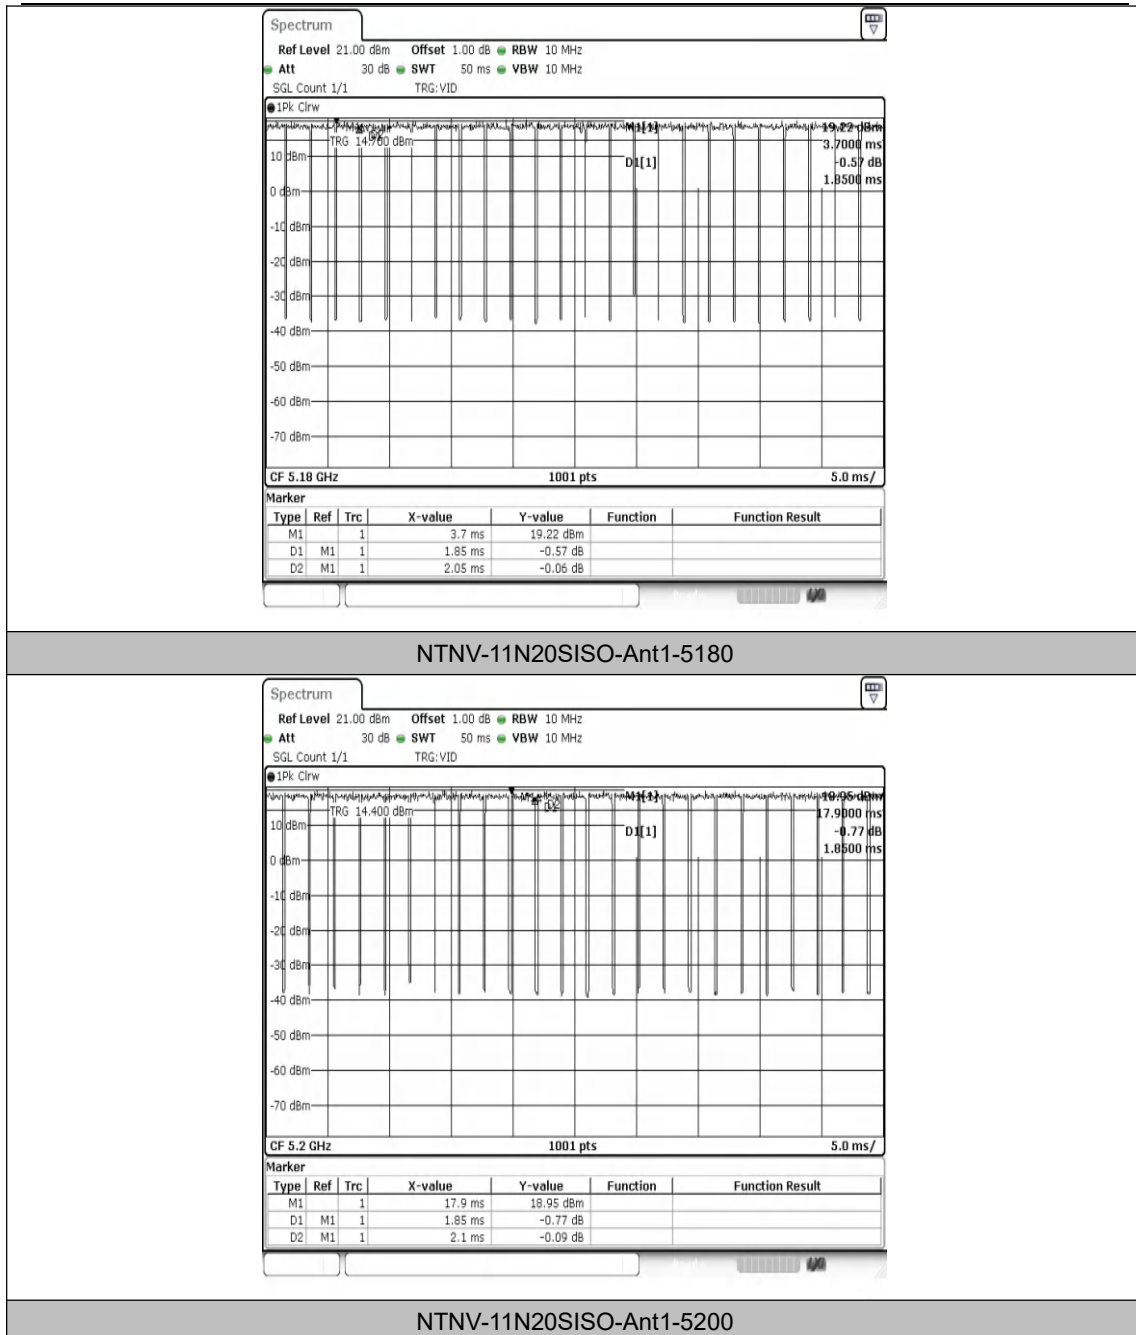


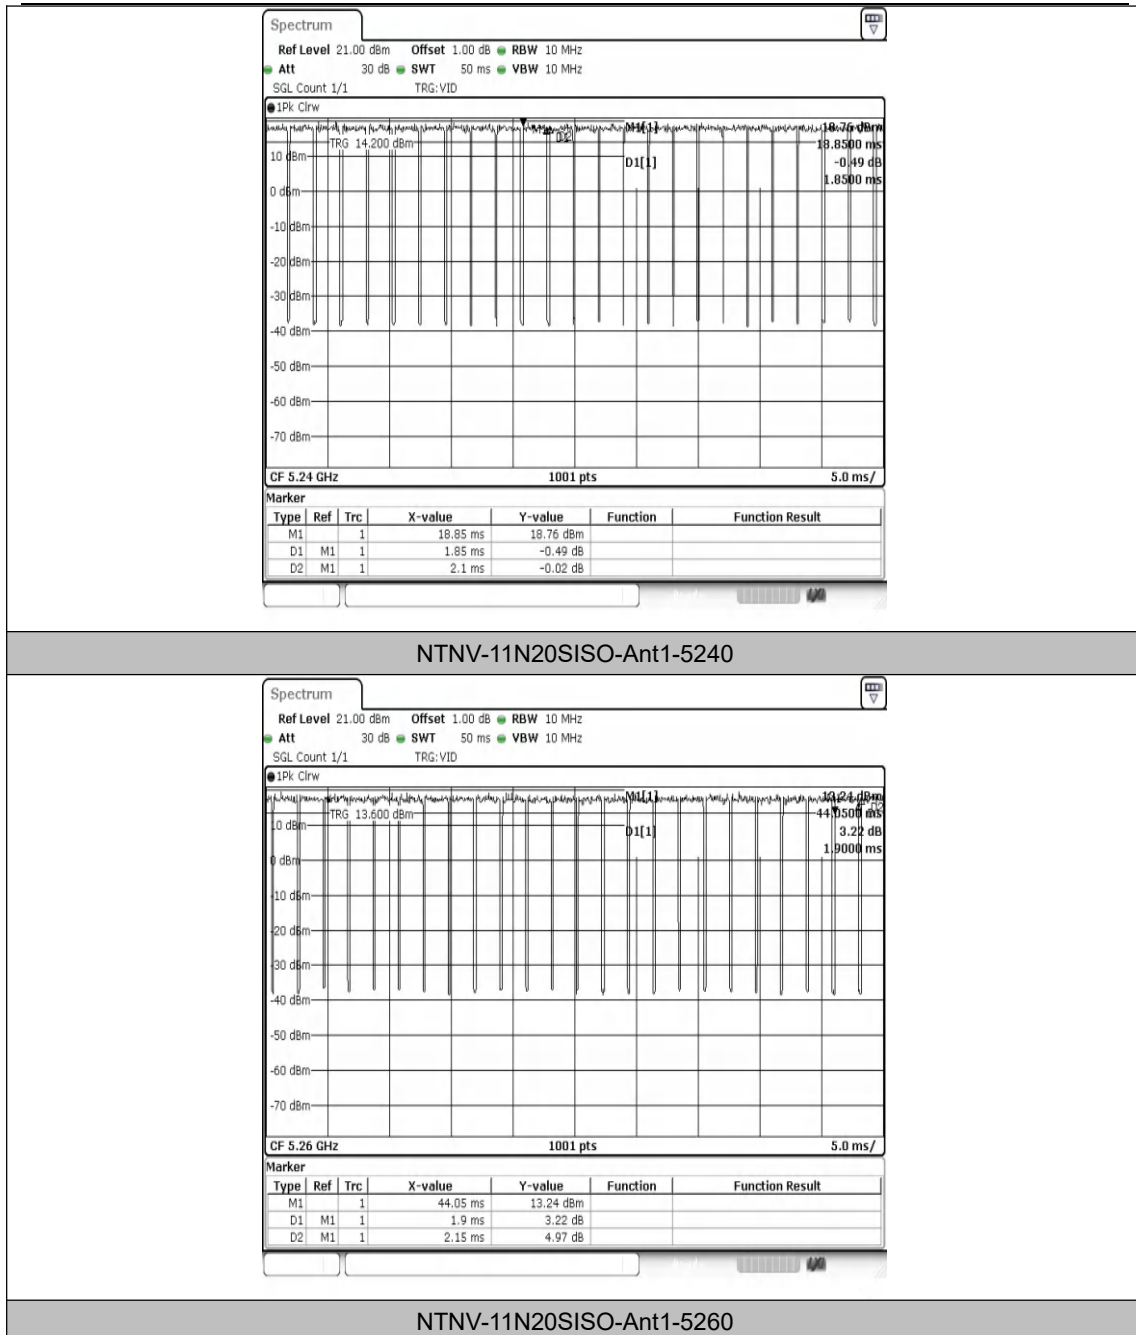

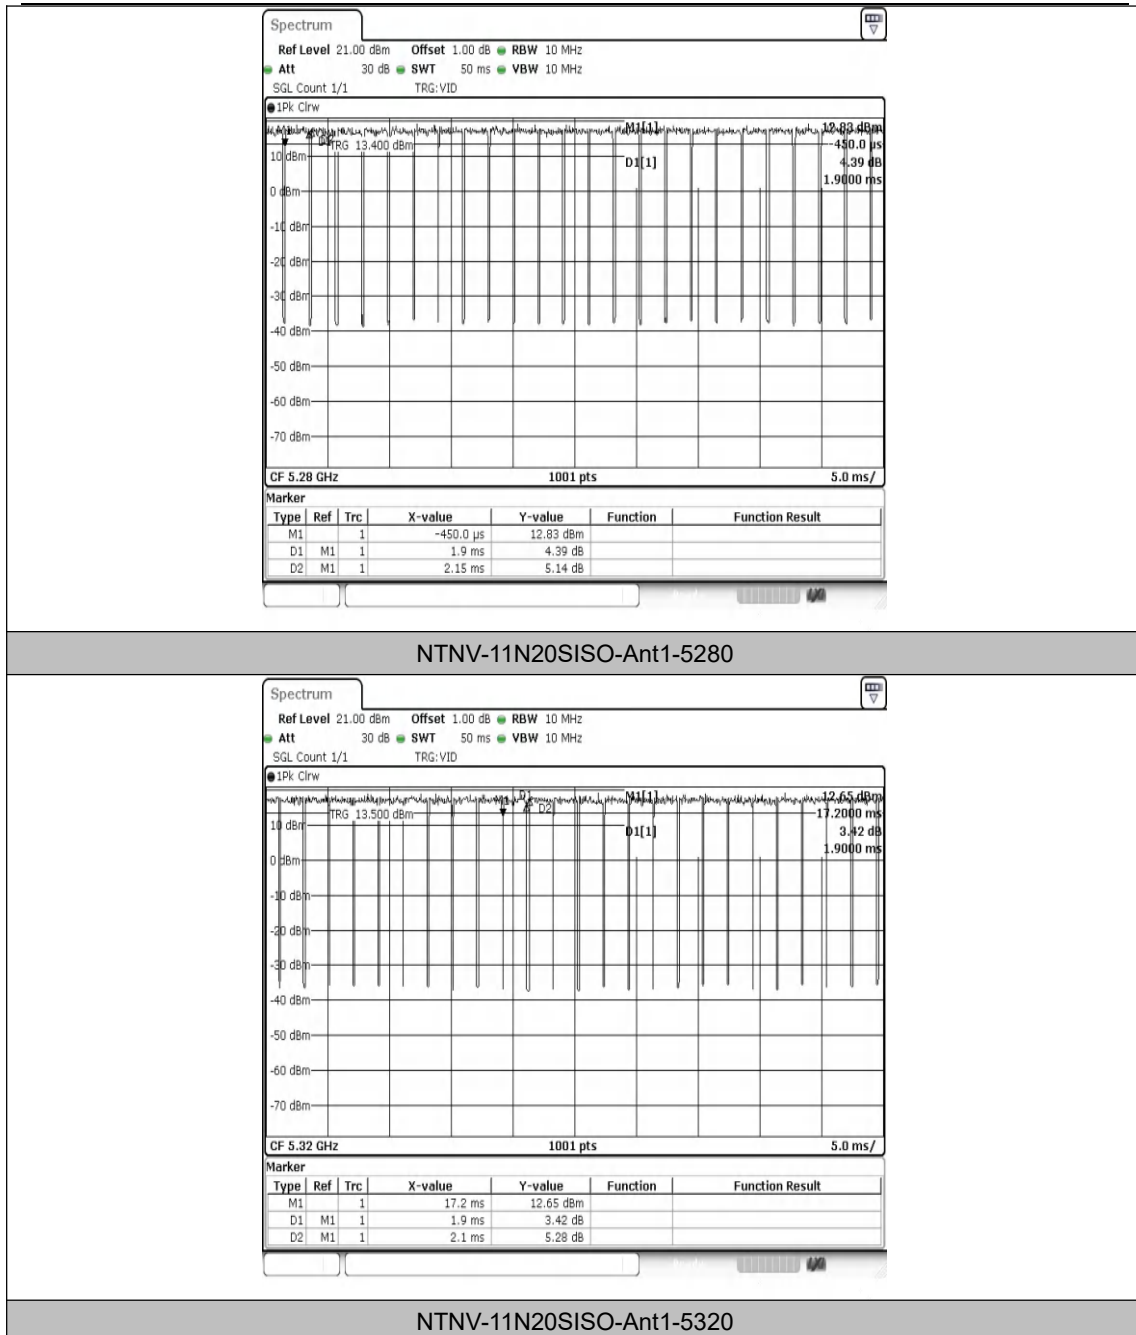

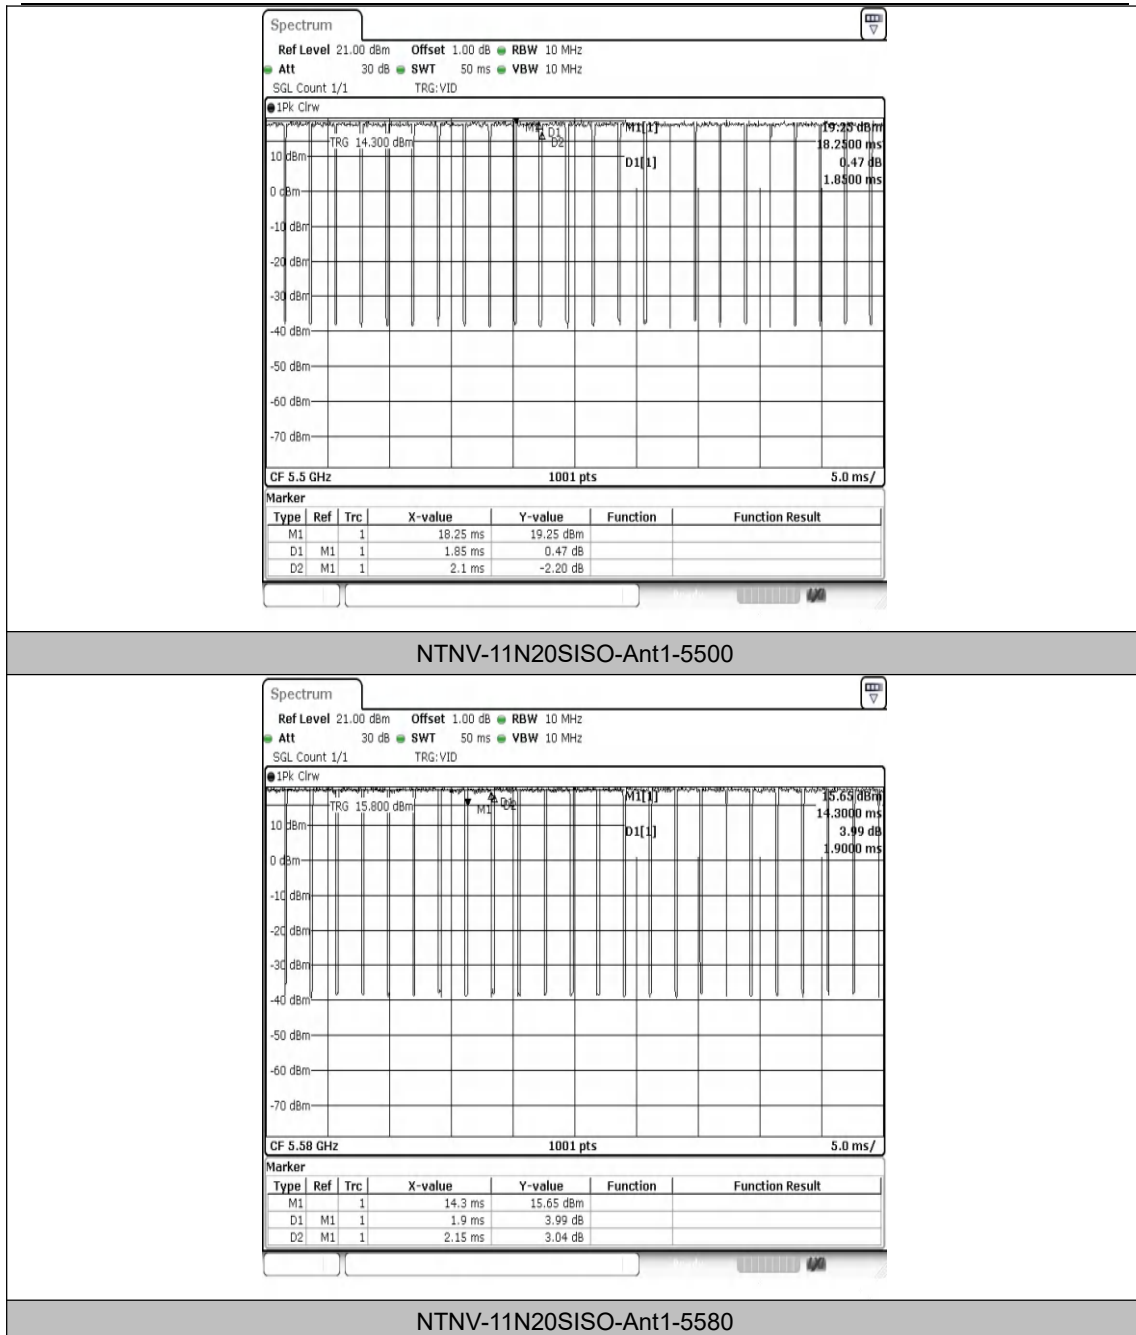

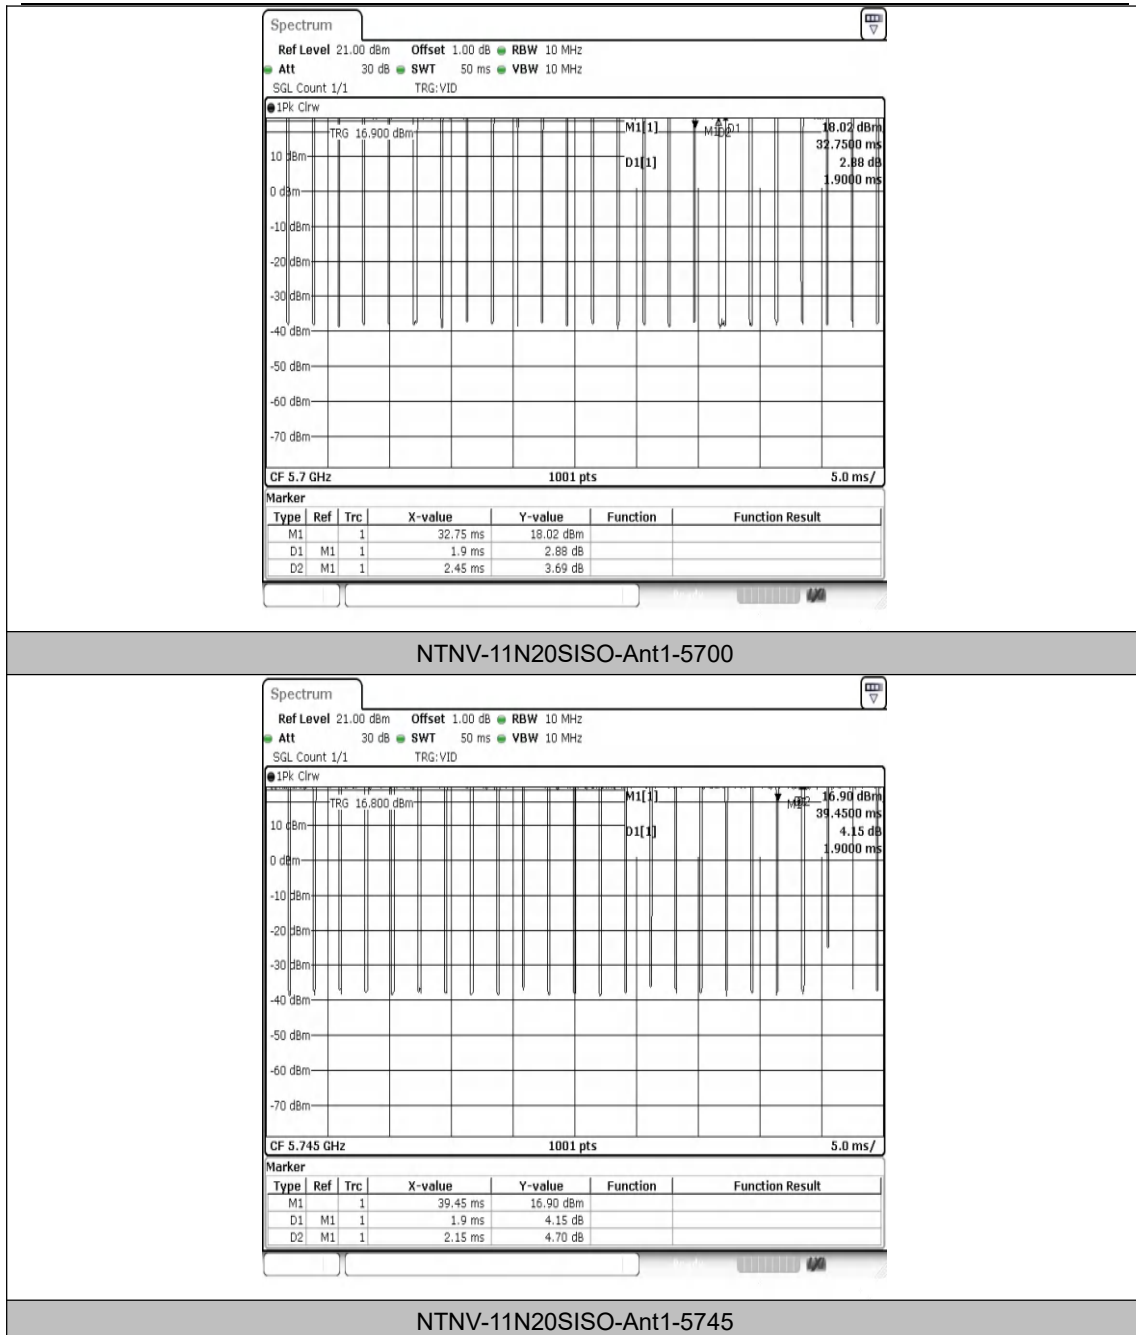


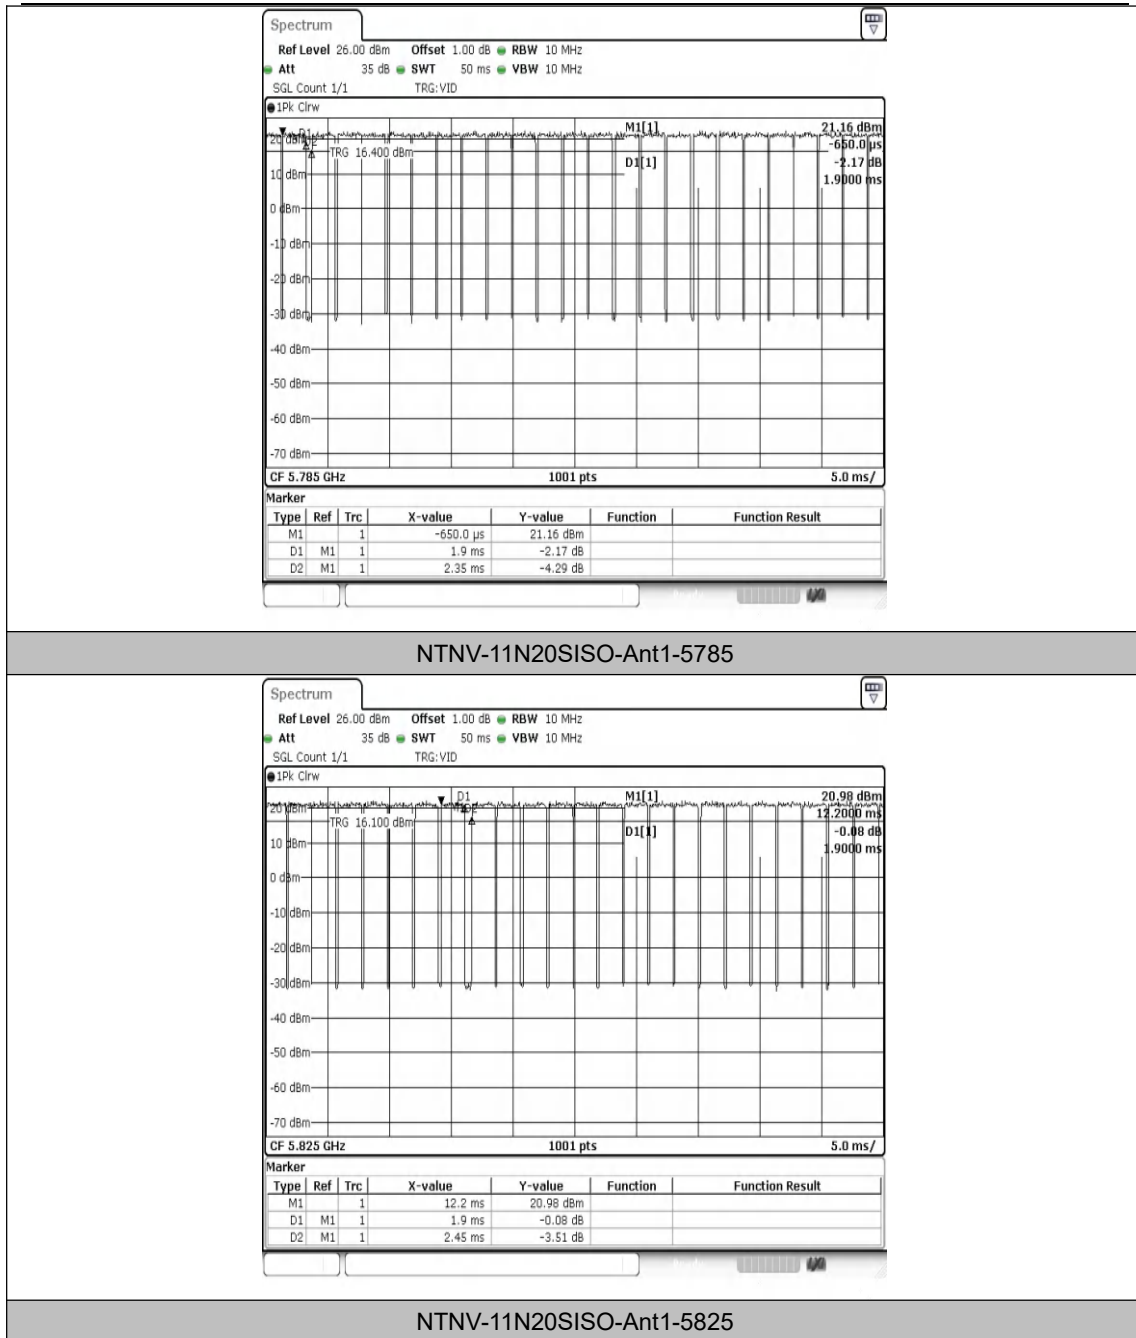



Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotech.com

Hotline
400-003-0500
www.anbotech.com

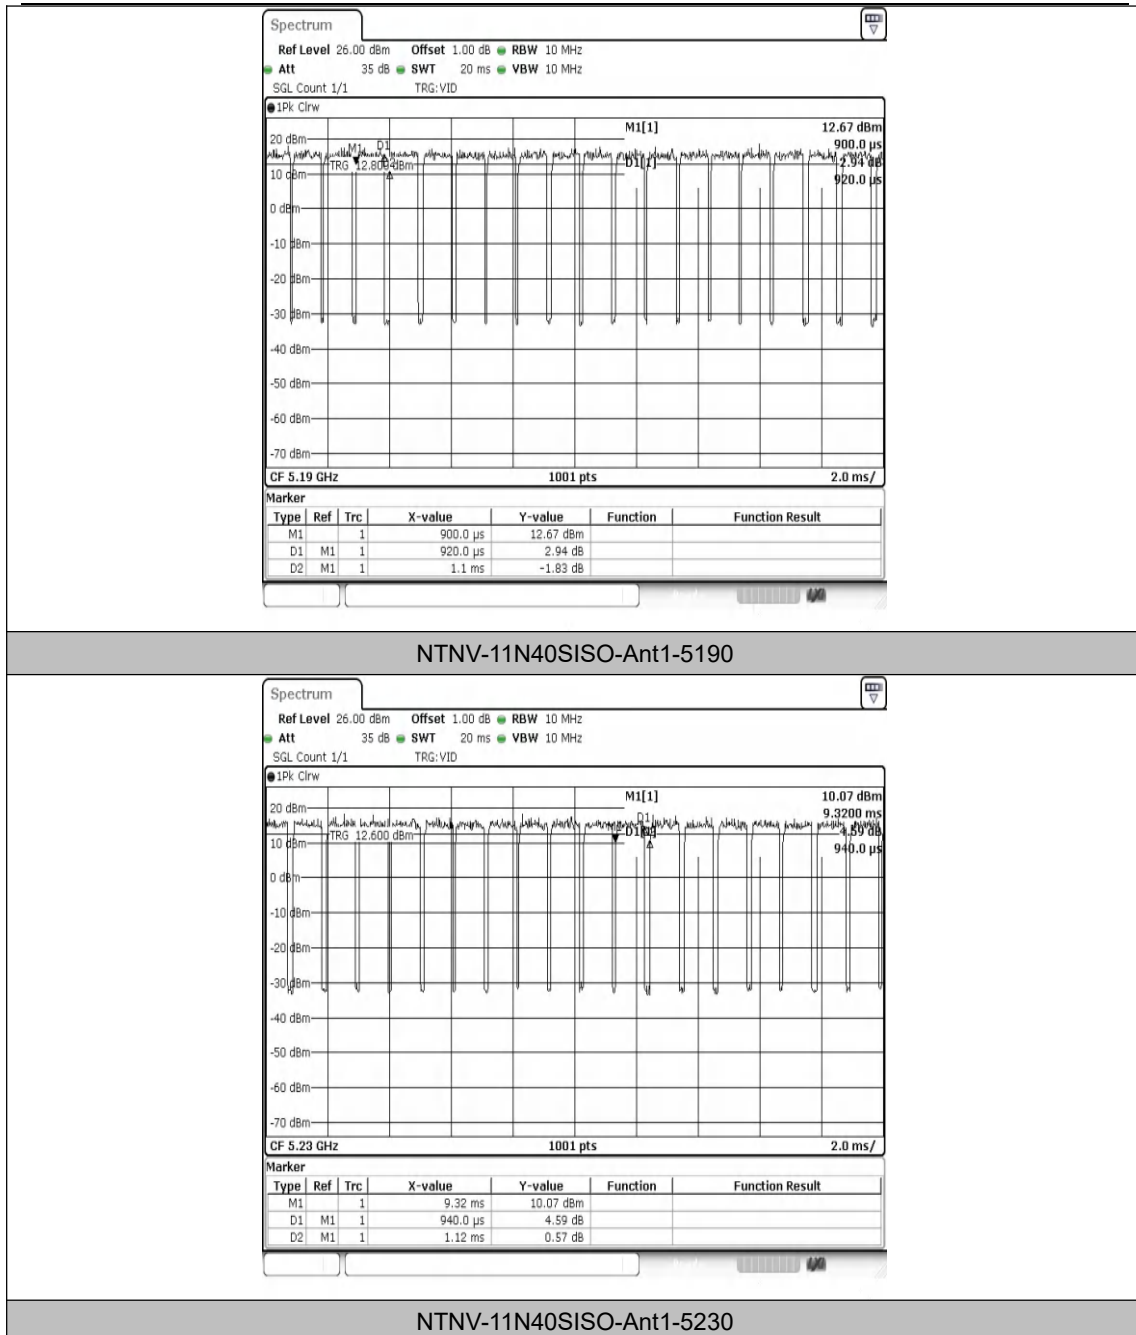

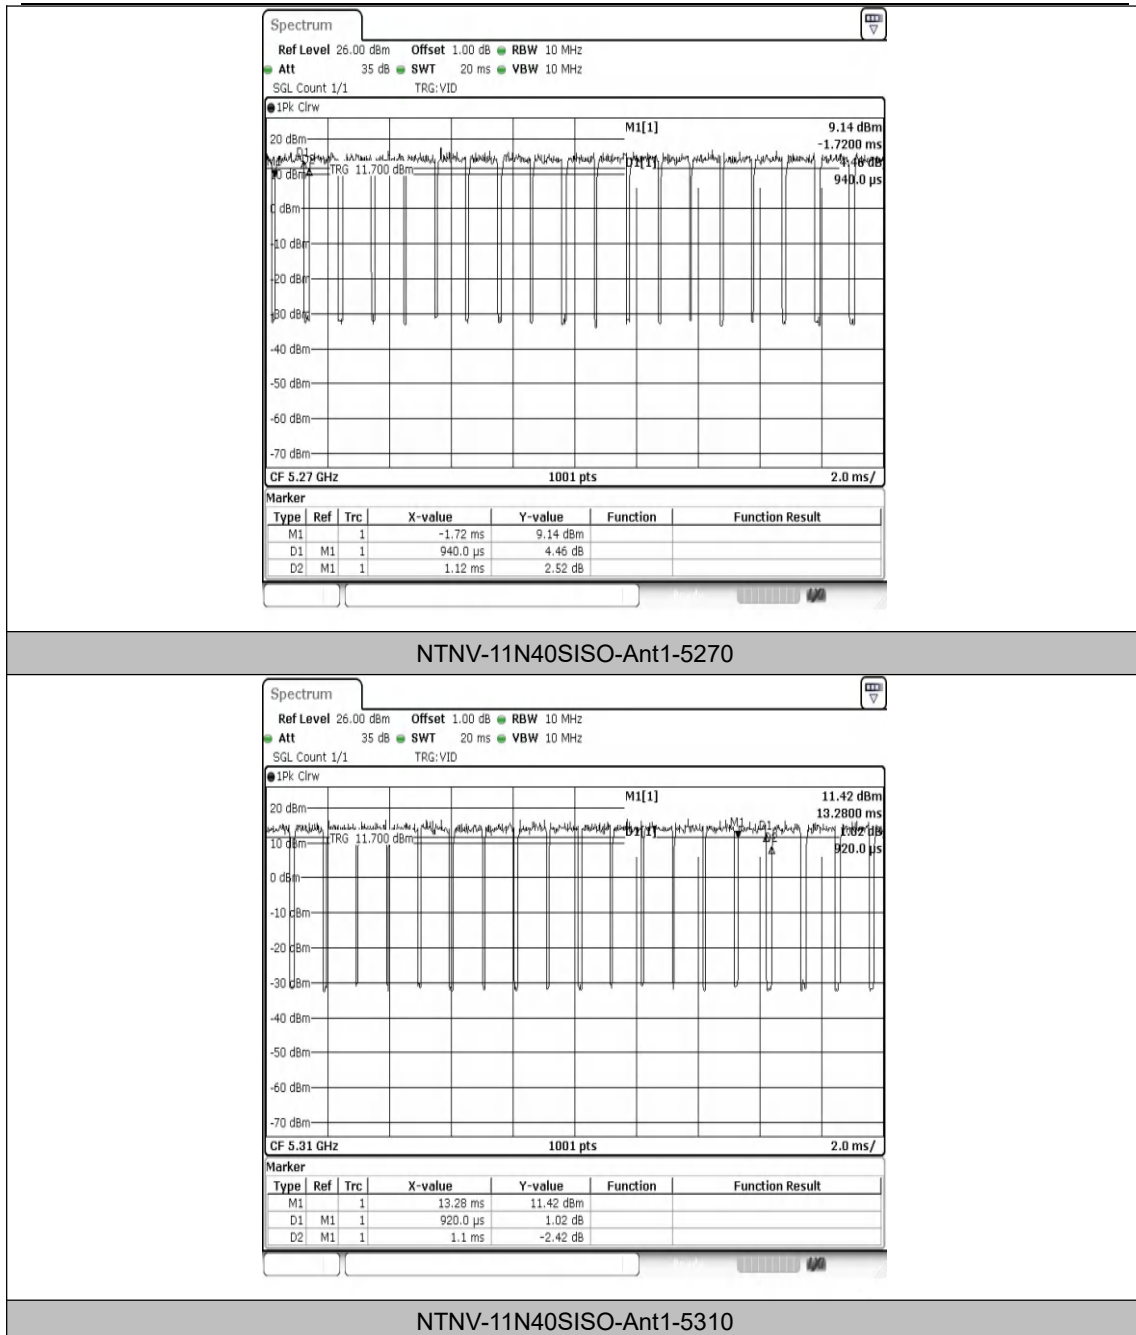


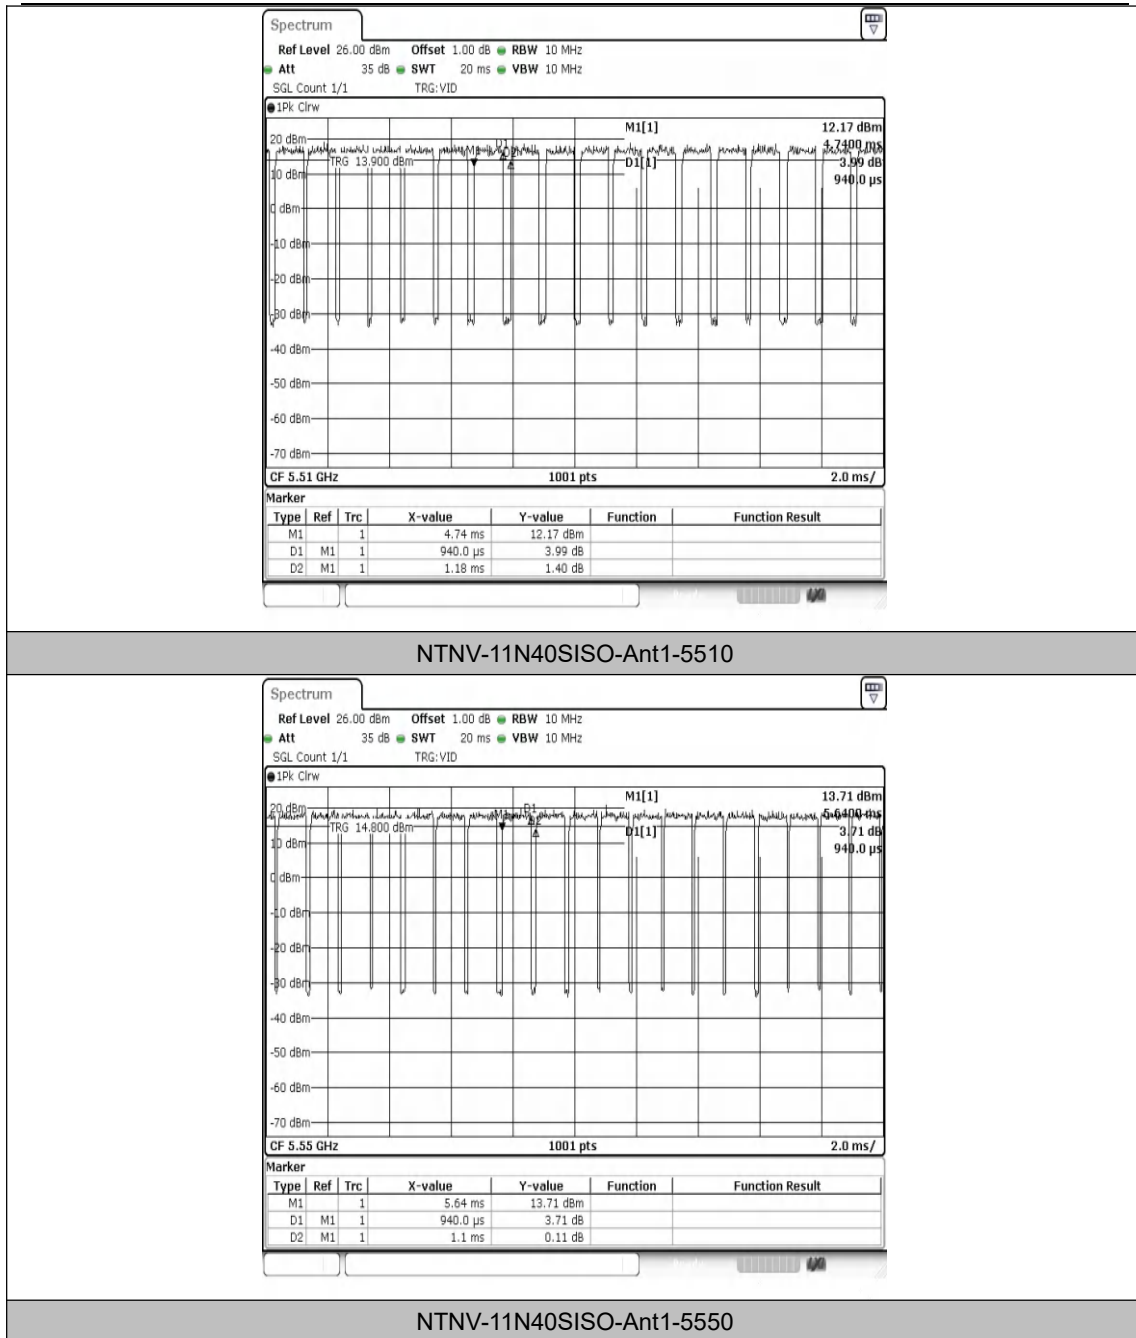



Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotek.com

Hotline
400-003-0500
www.anbotek.com

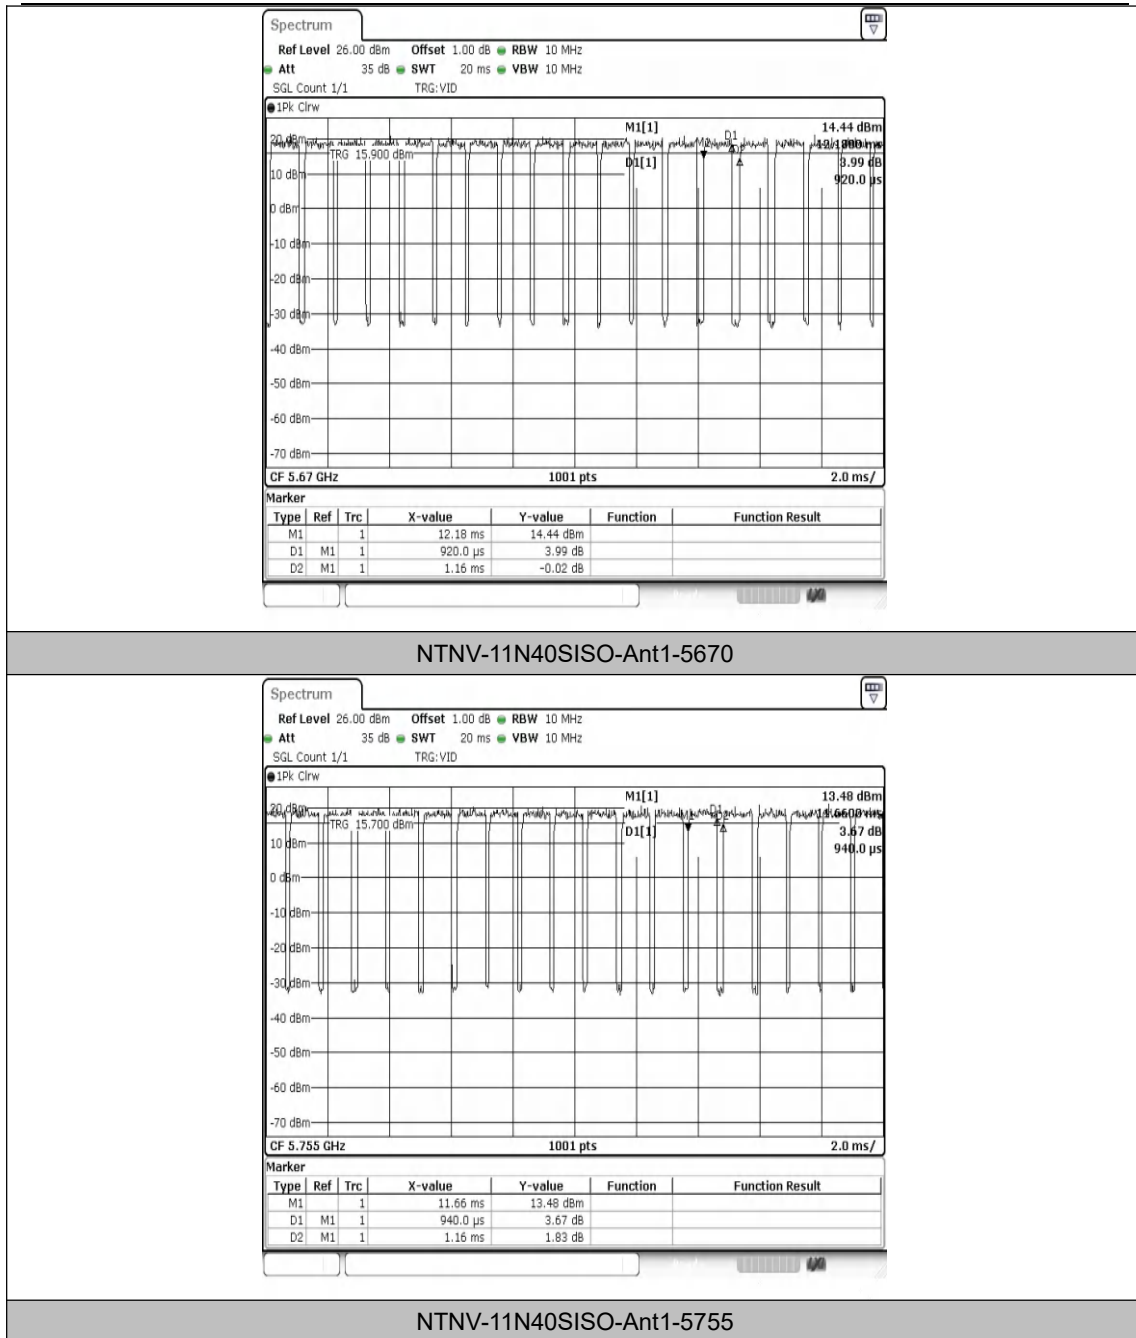

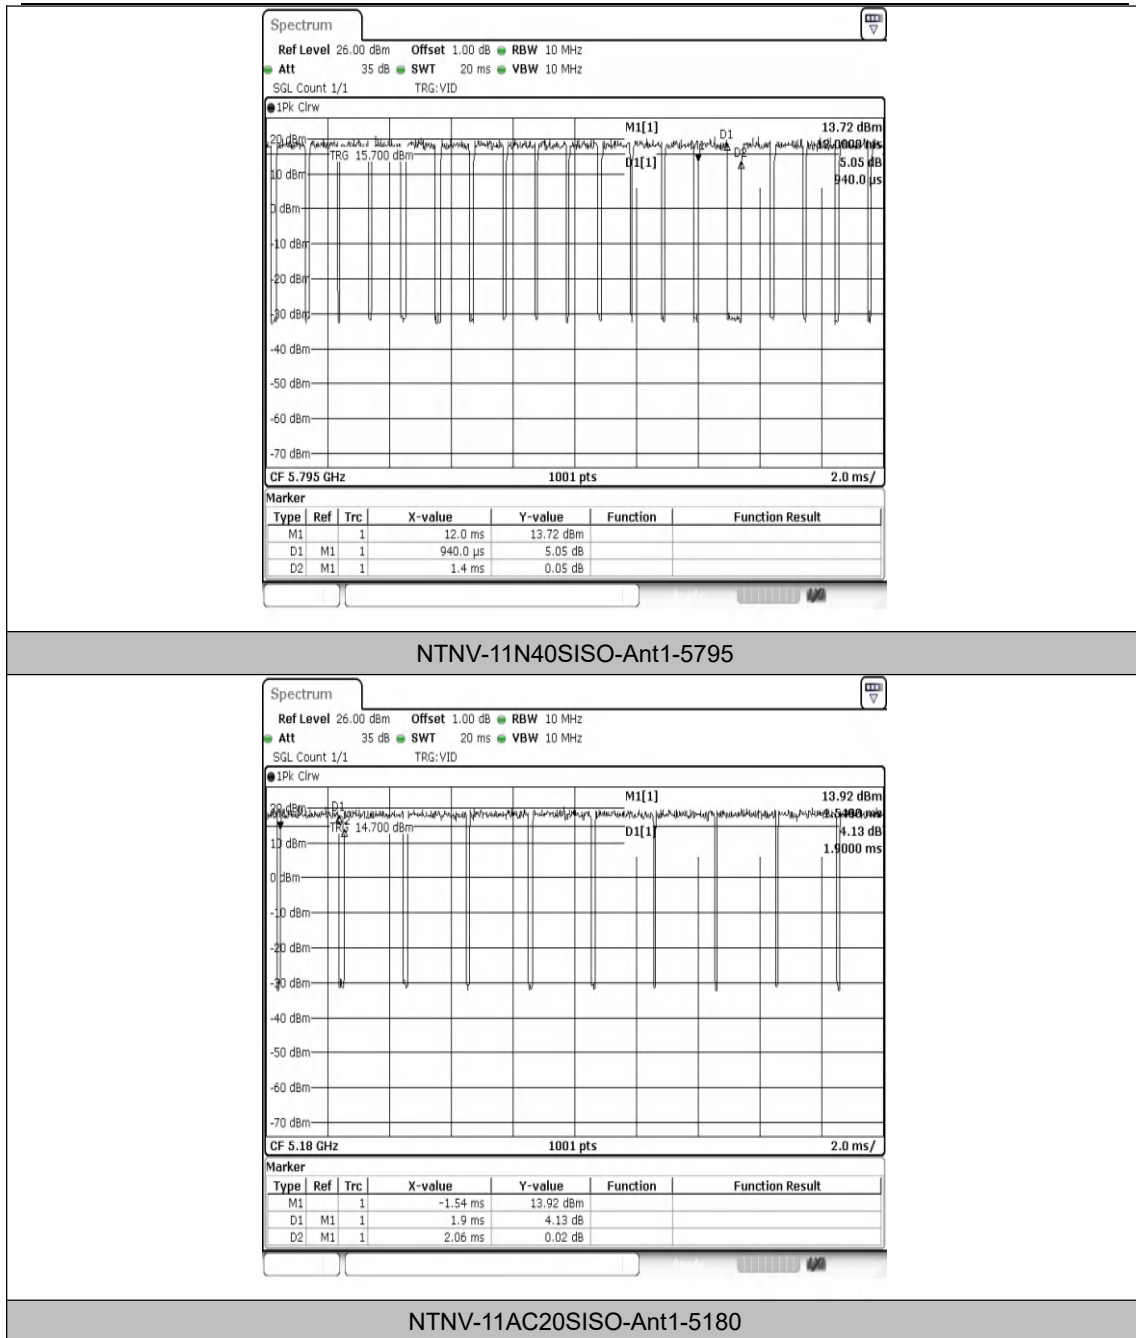


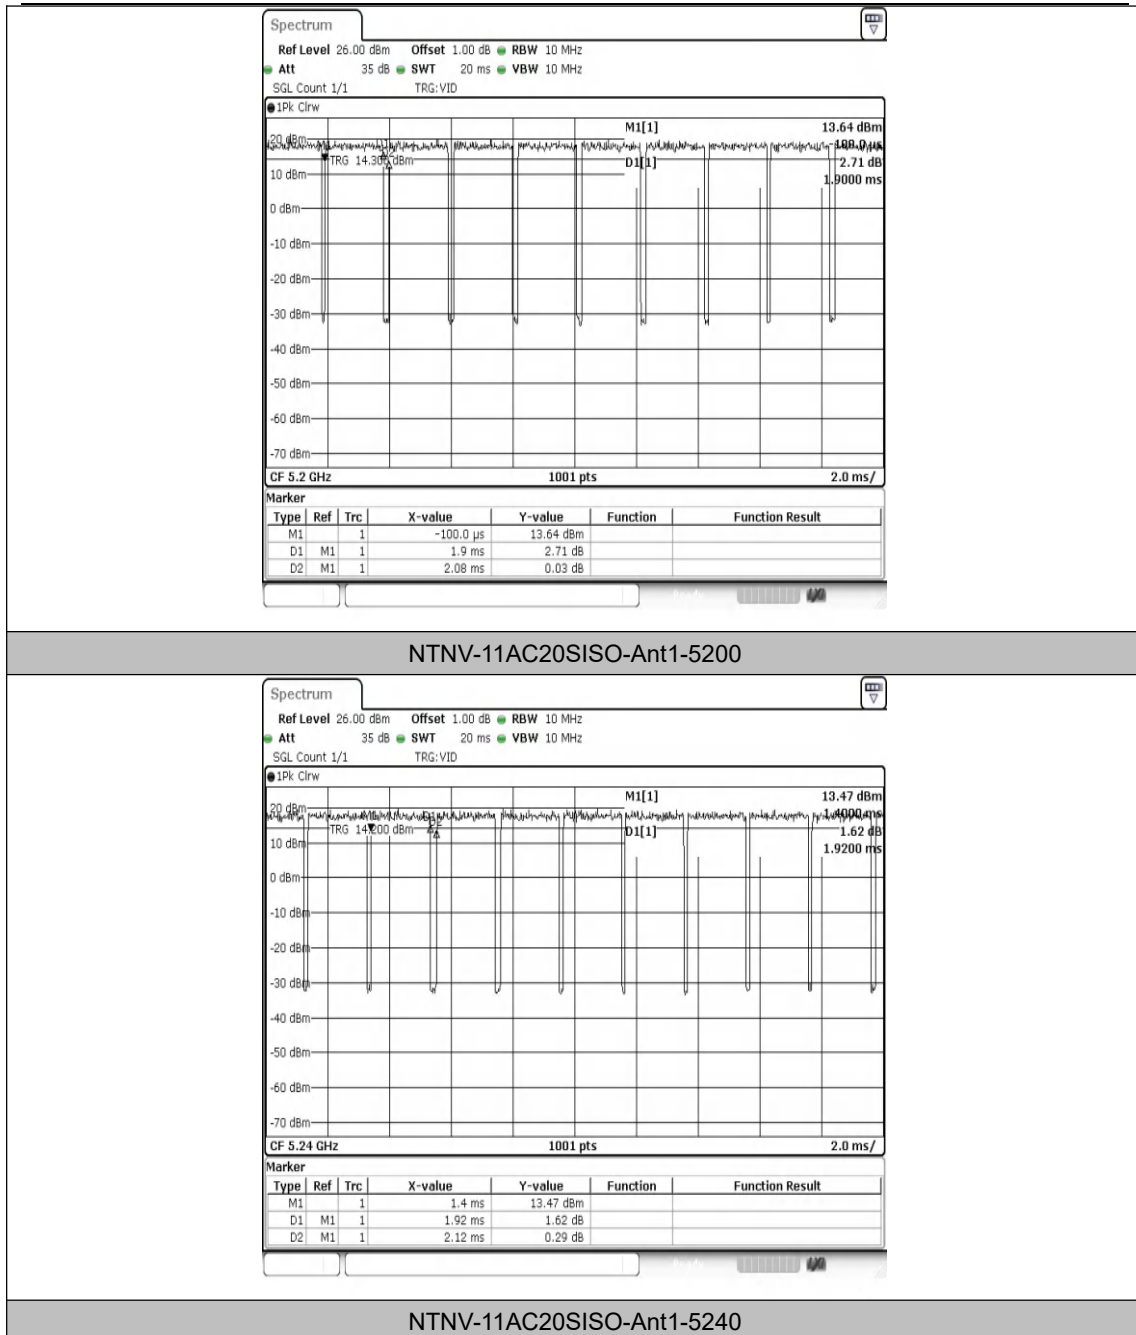



Shenzhen Anbotek Compliance Laboratory Limited


Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

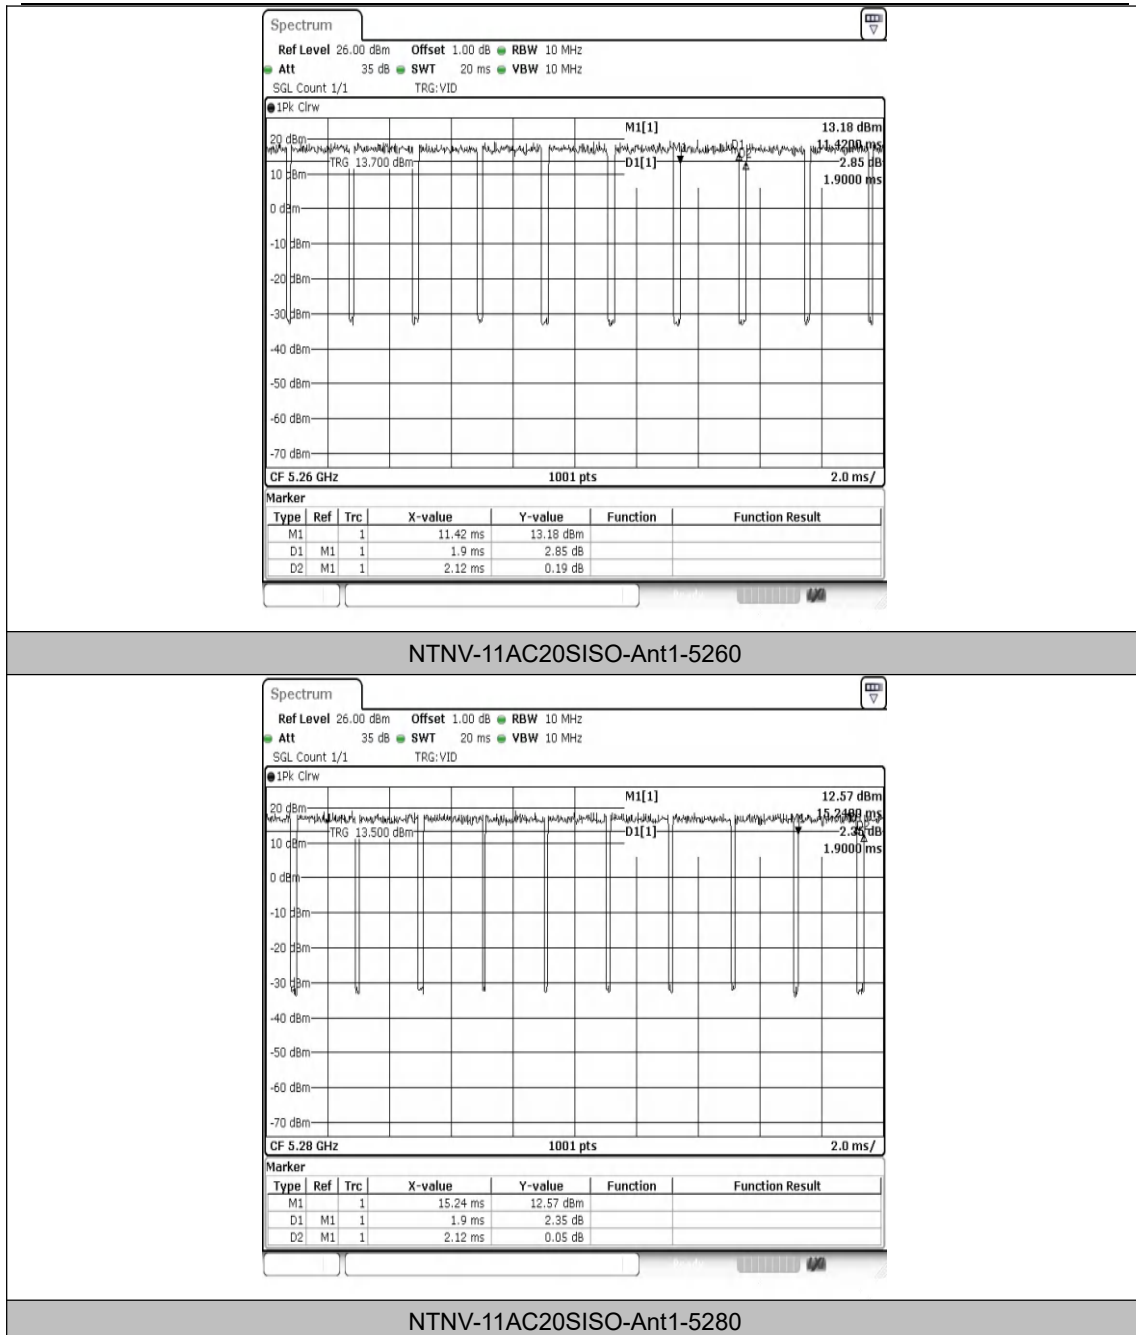


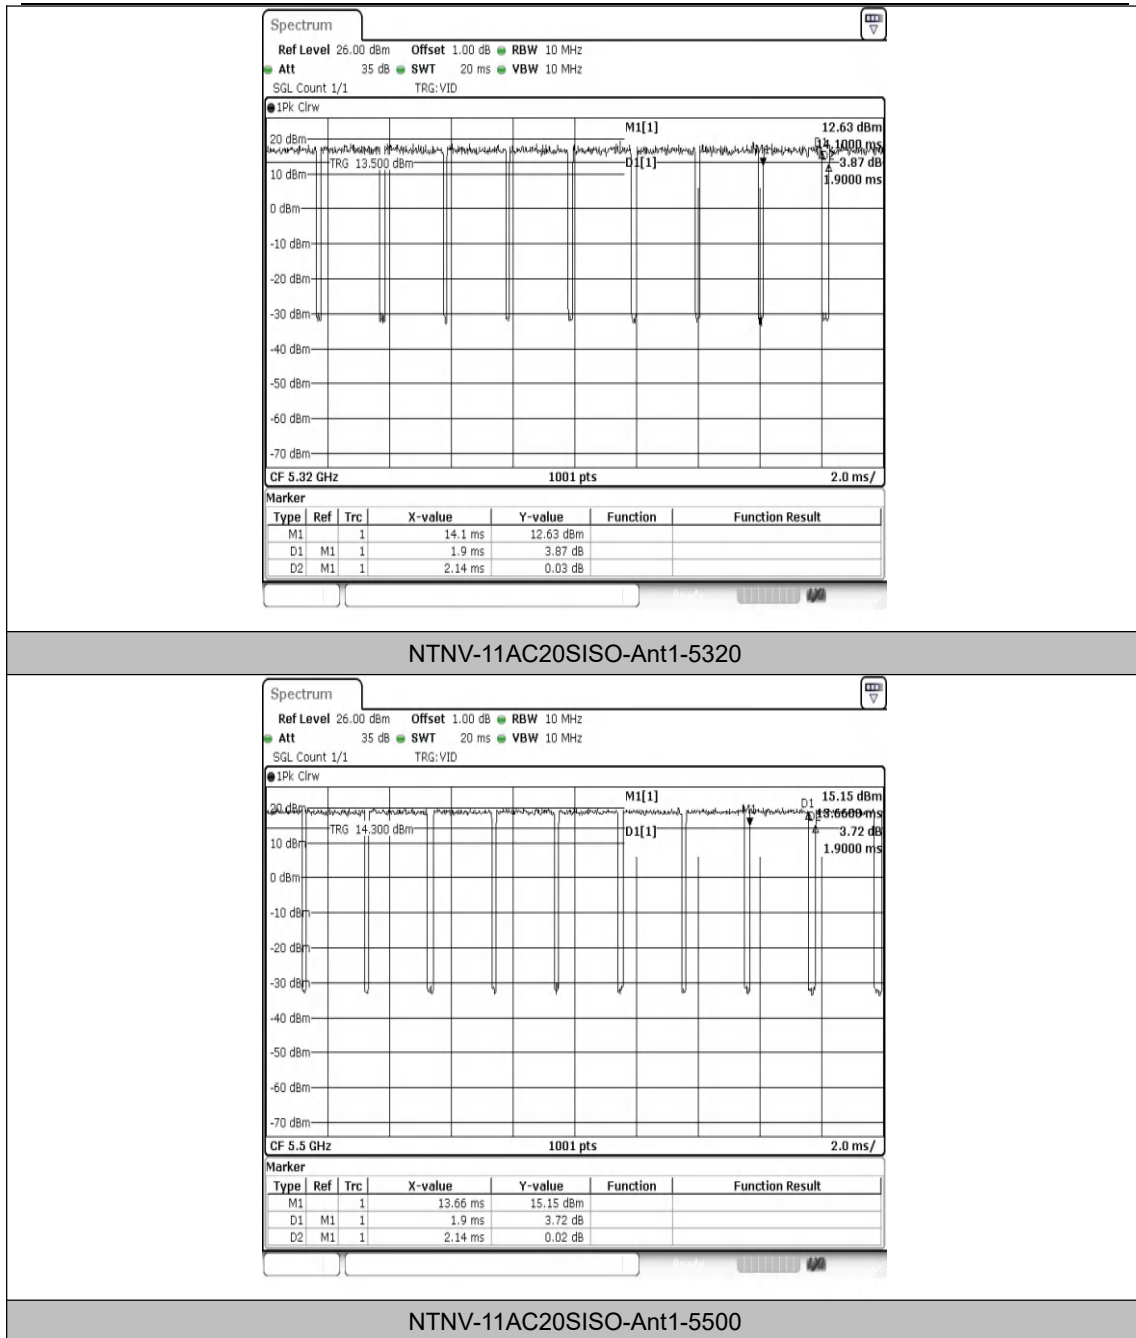


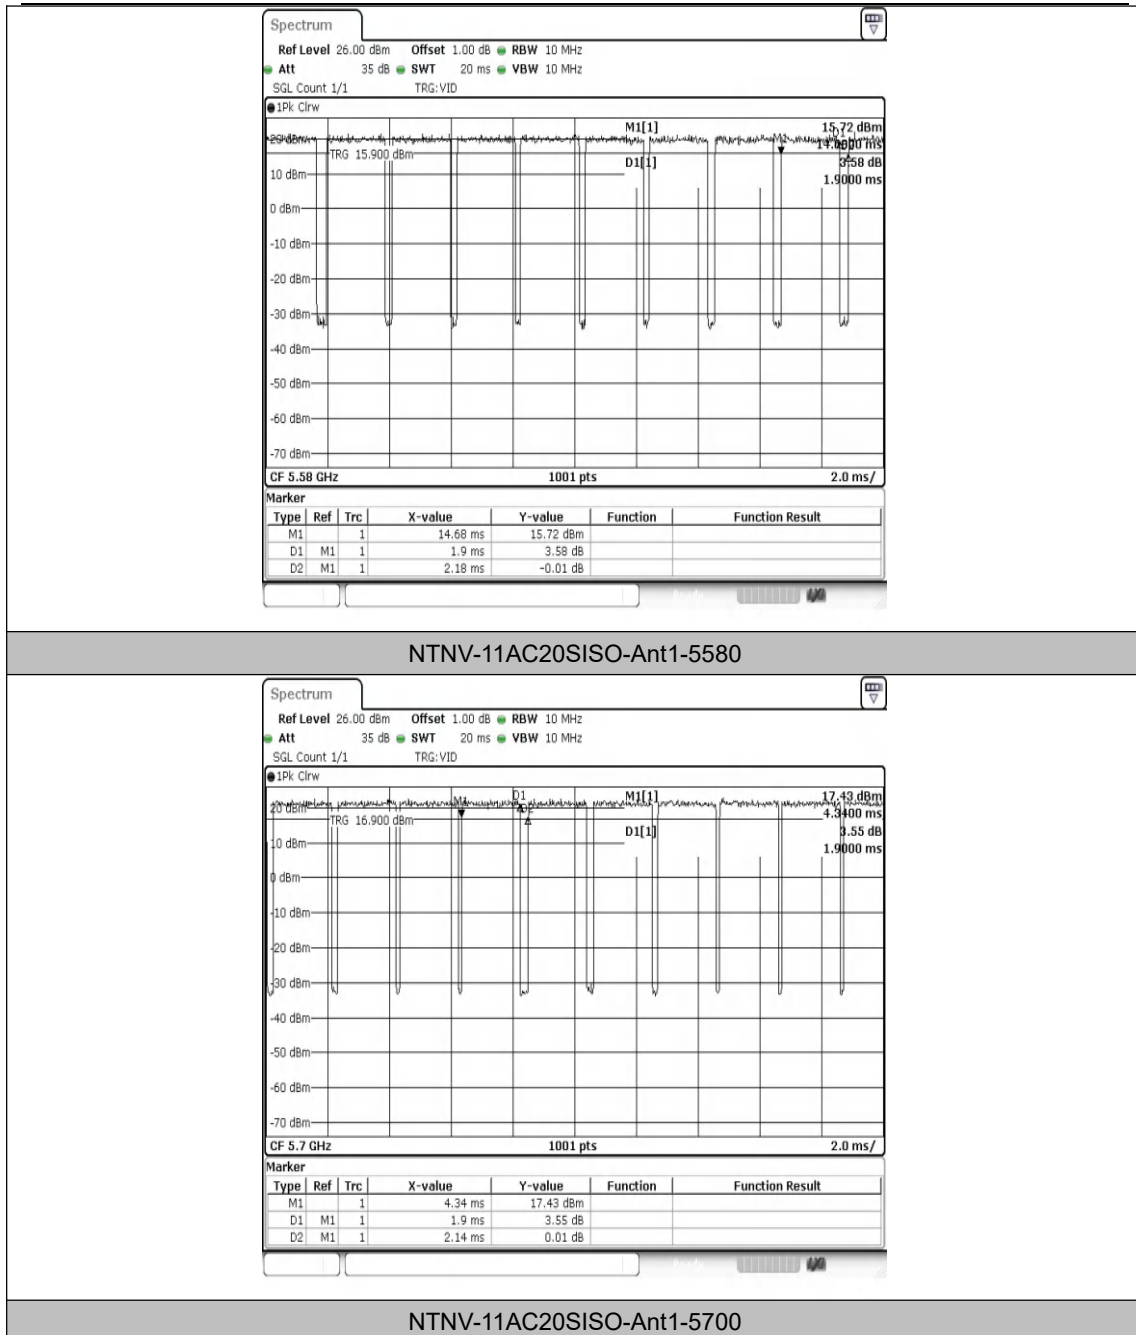


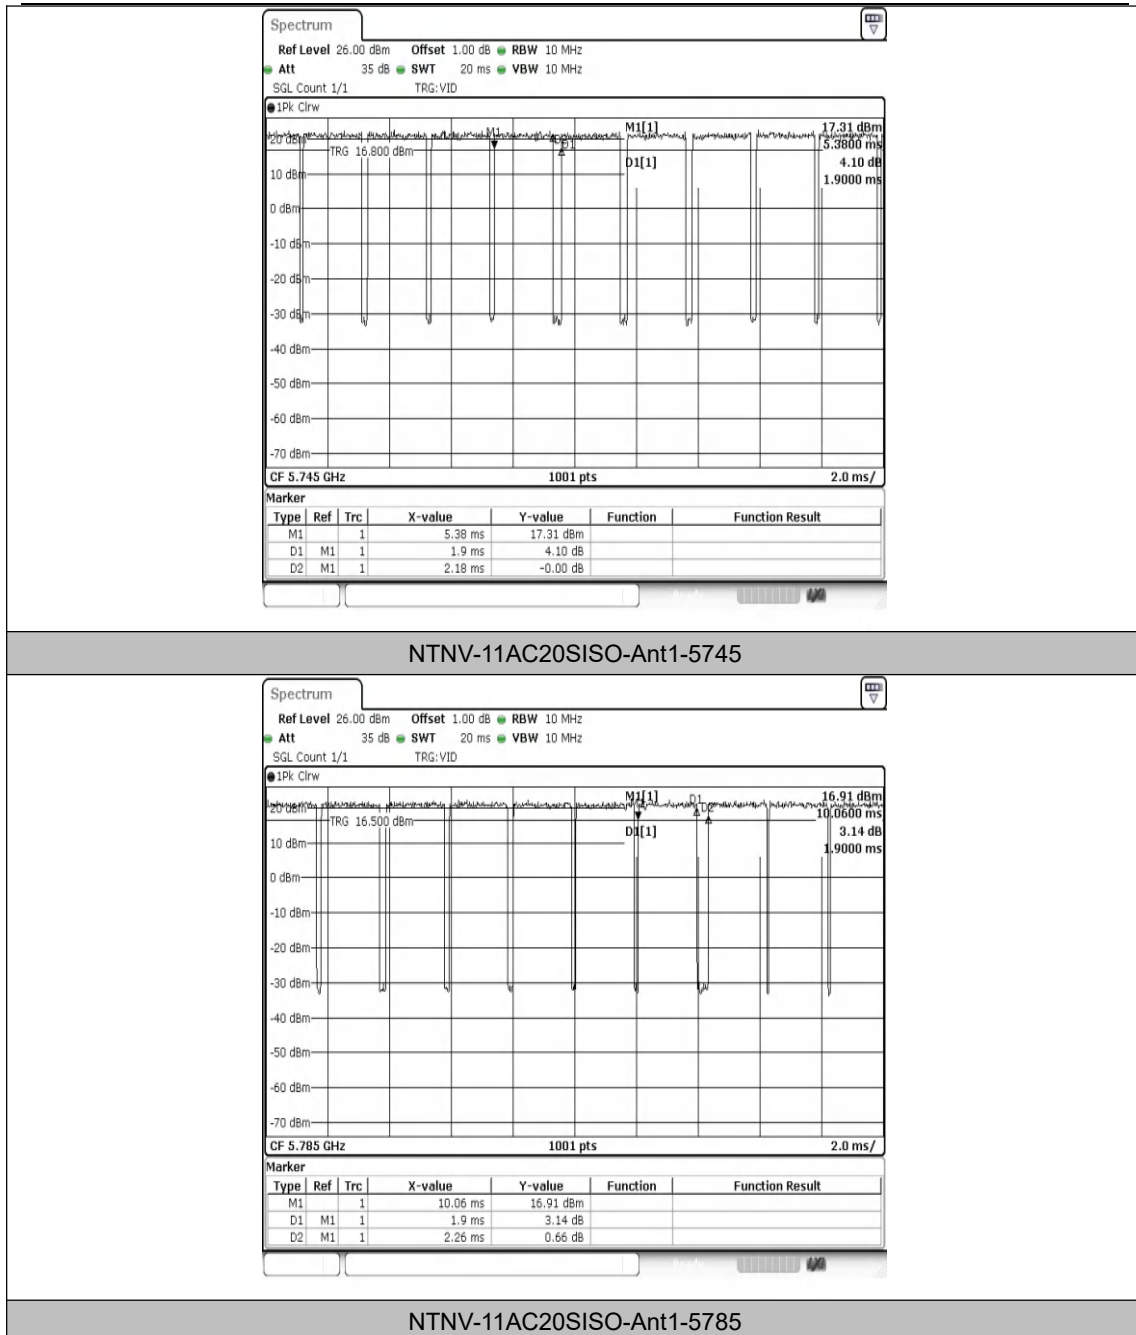


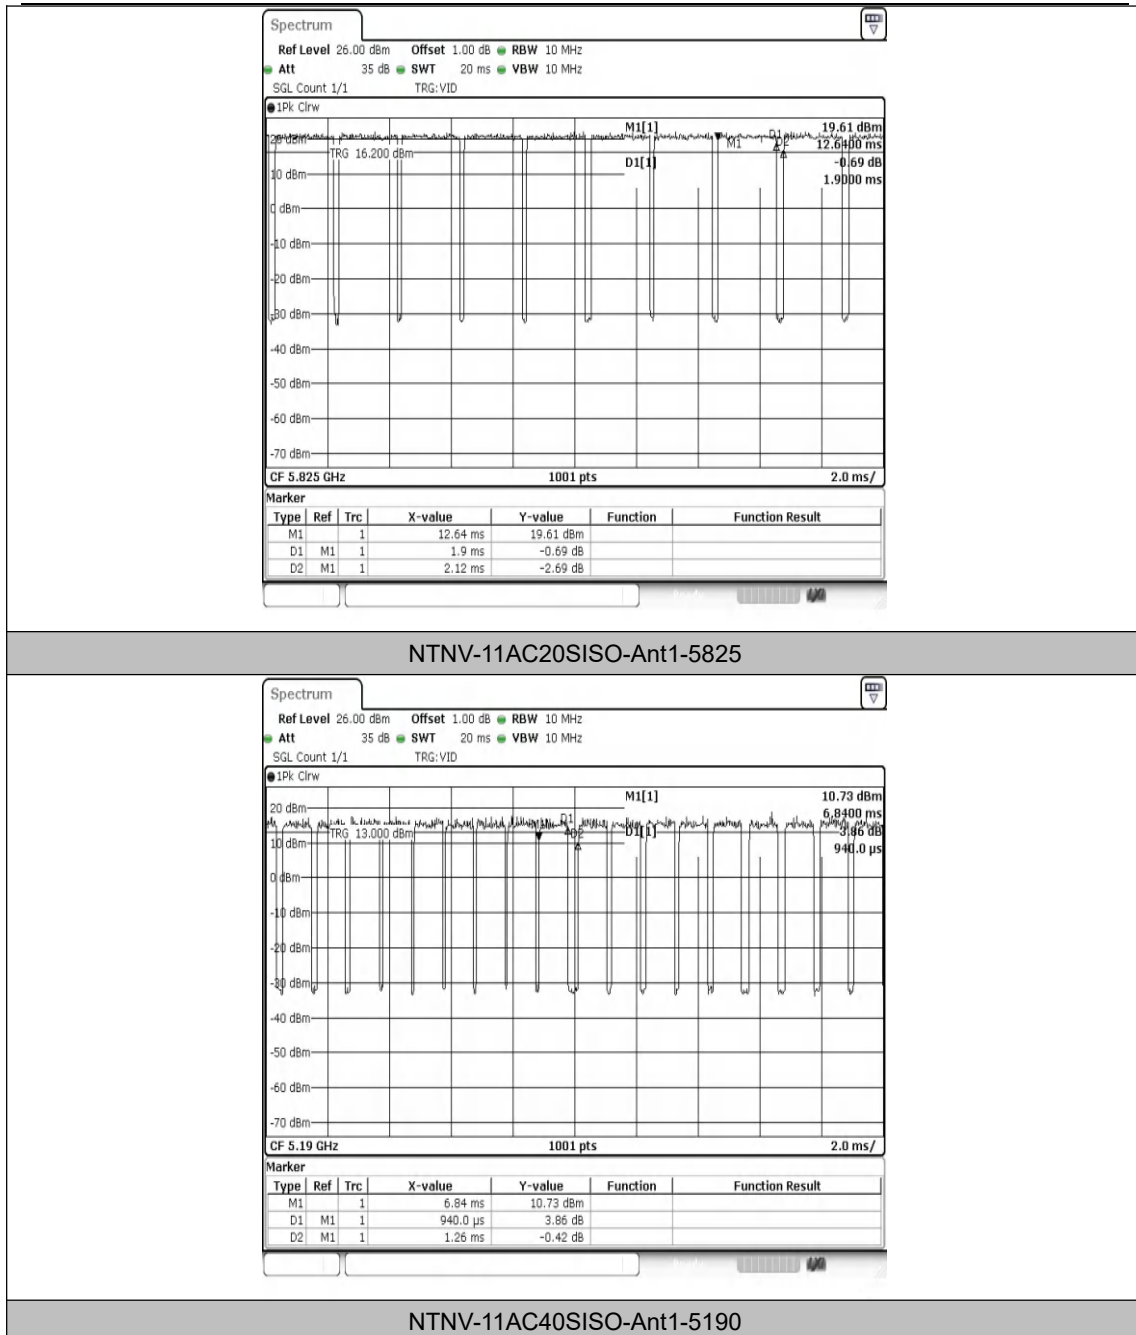


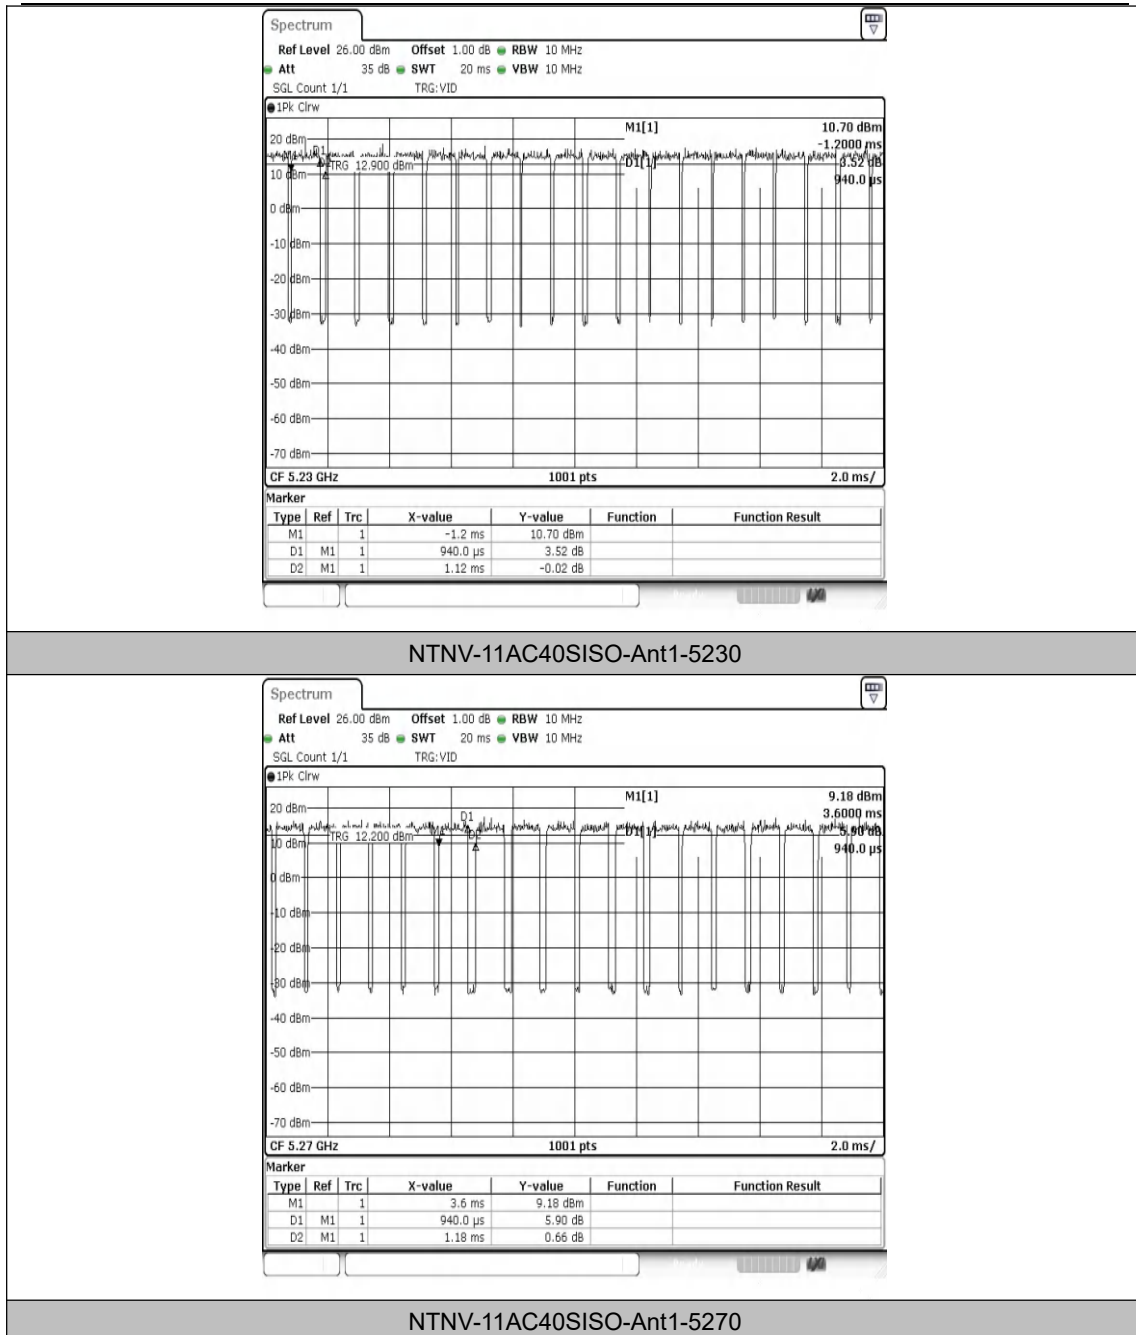


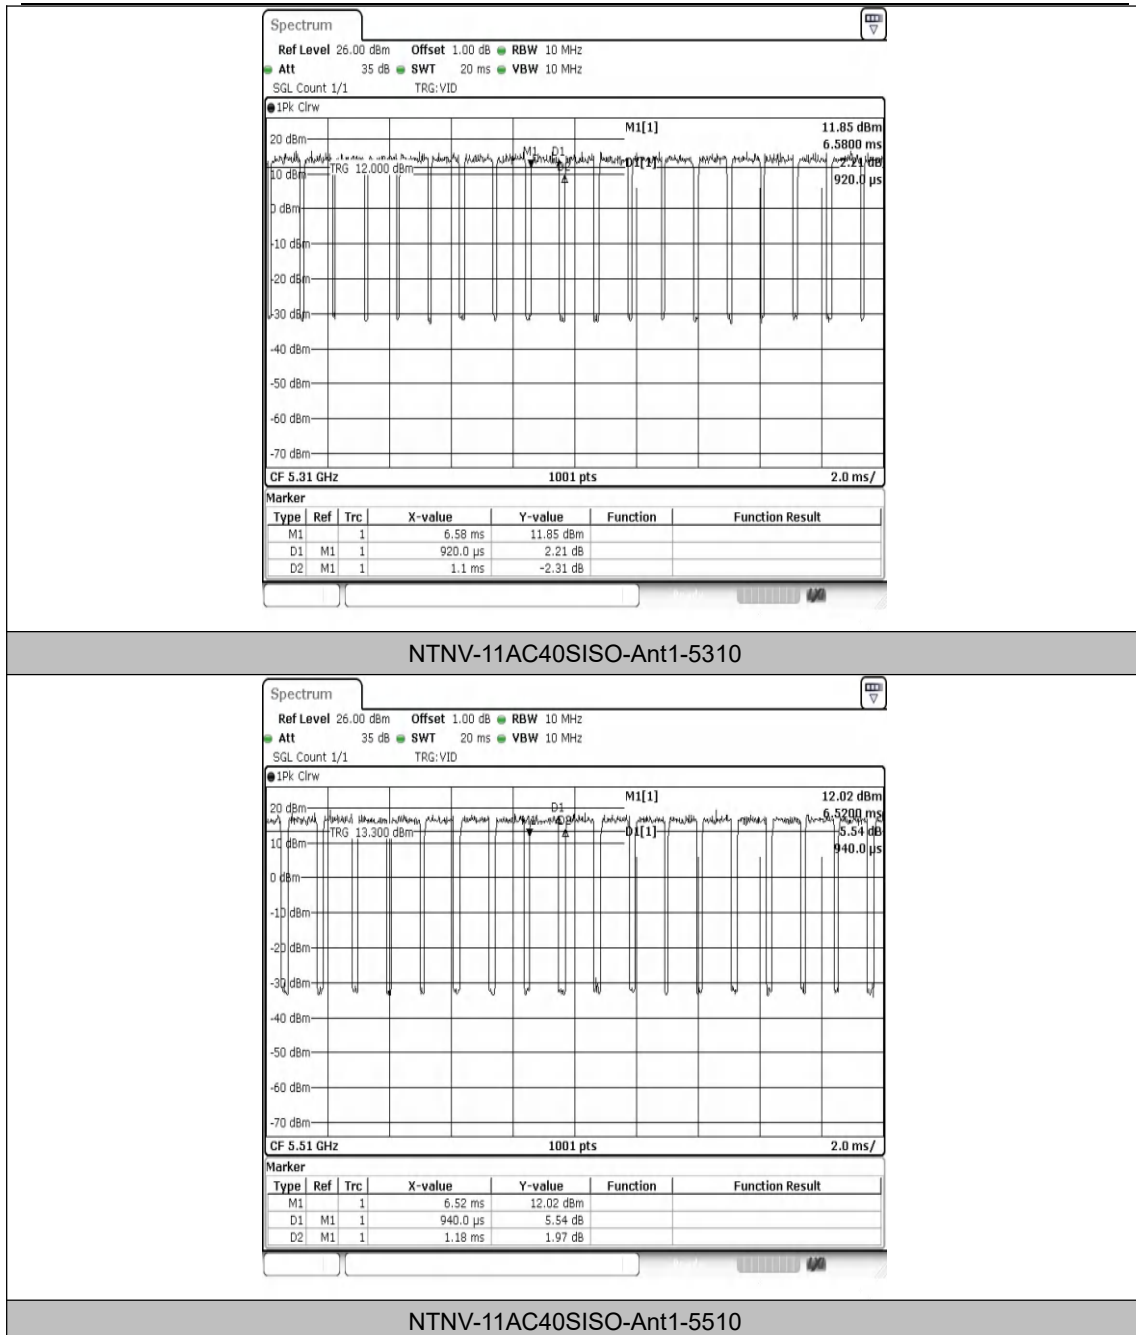


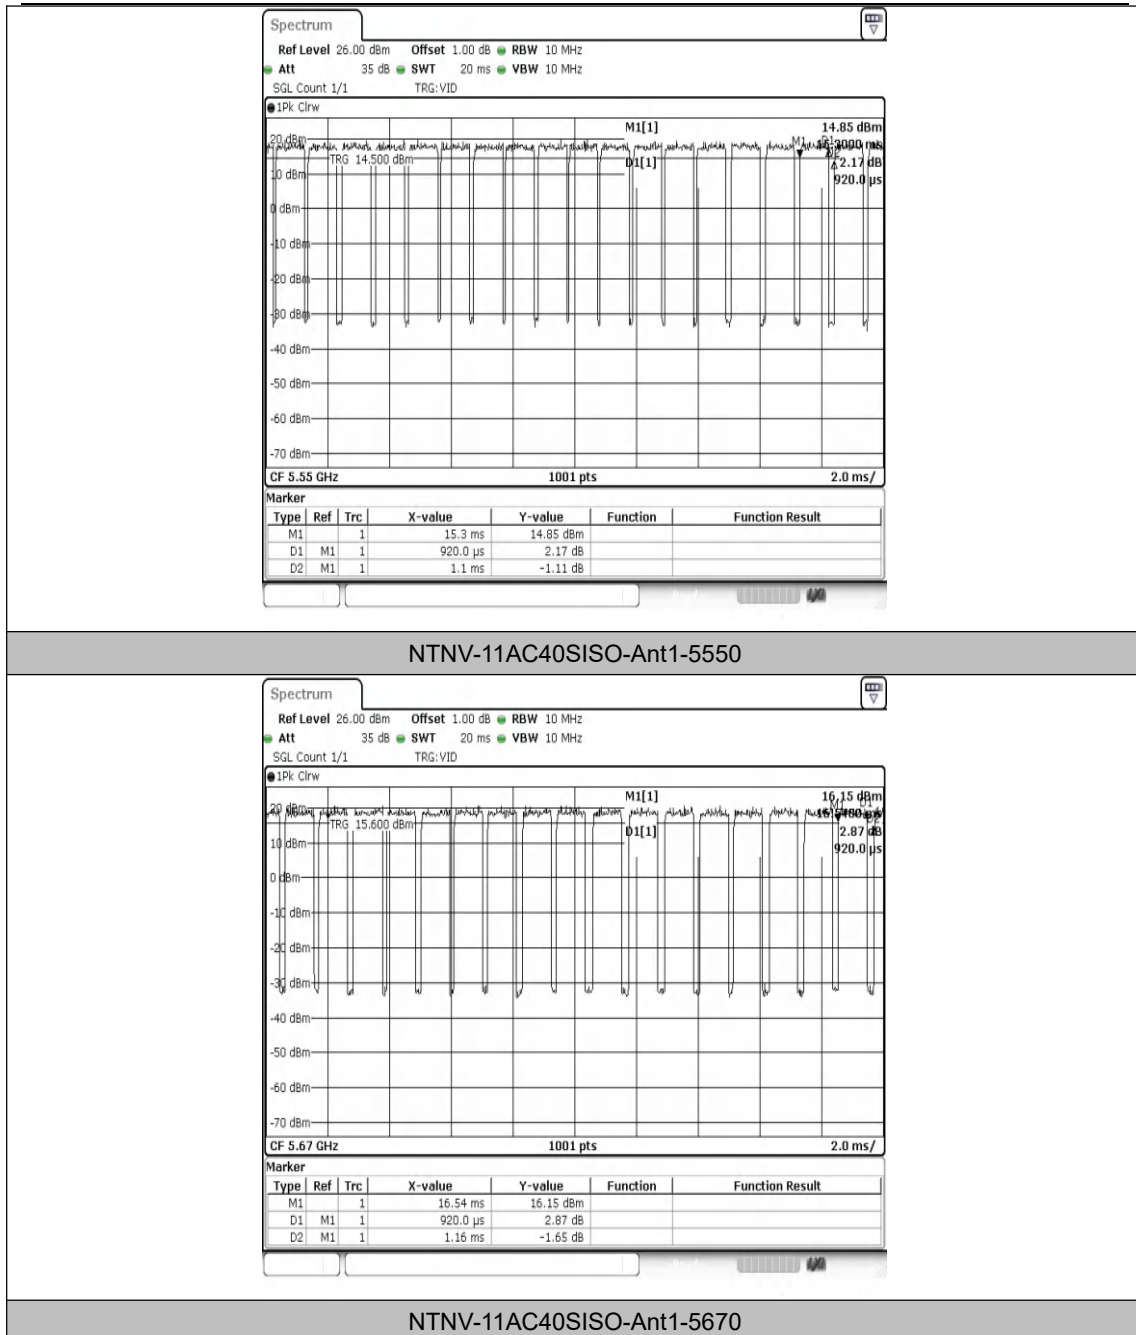

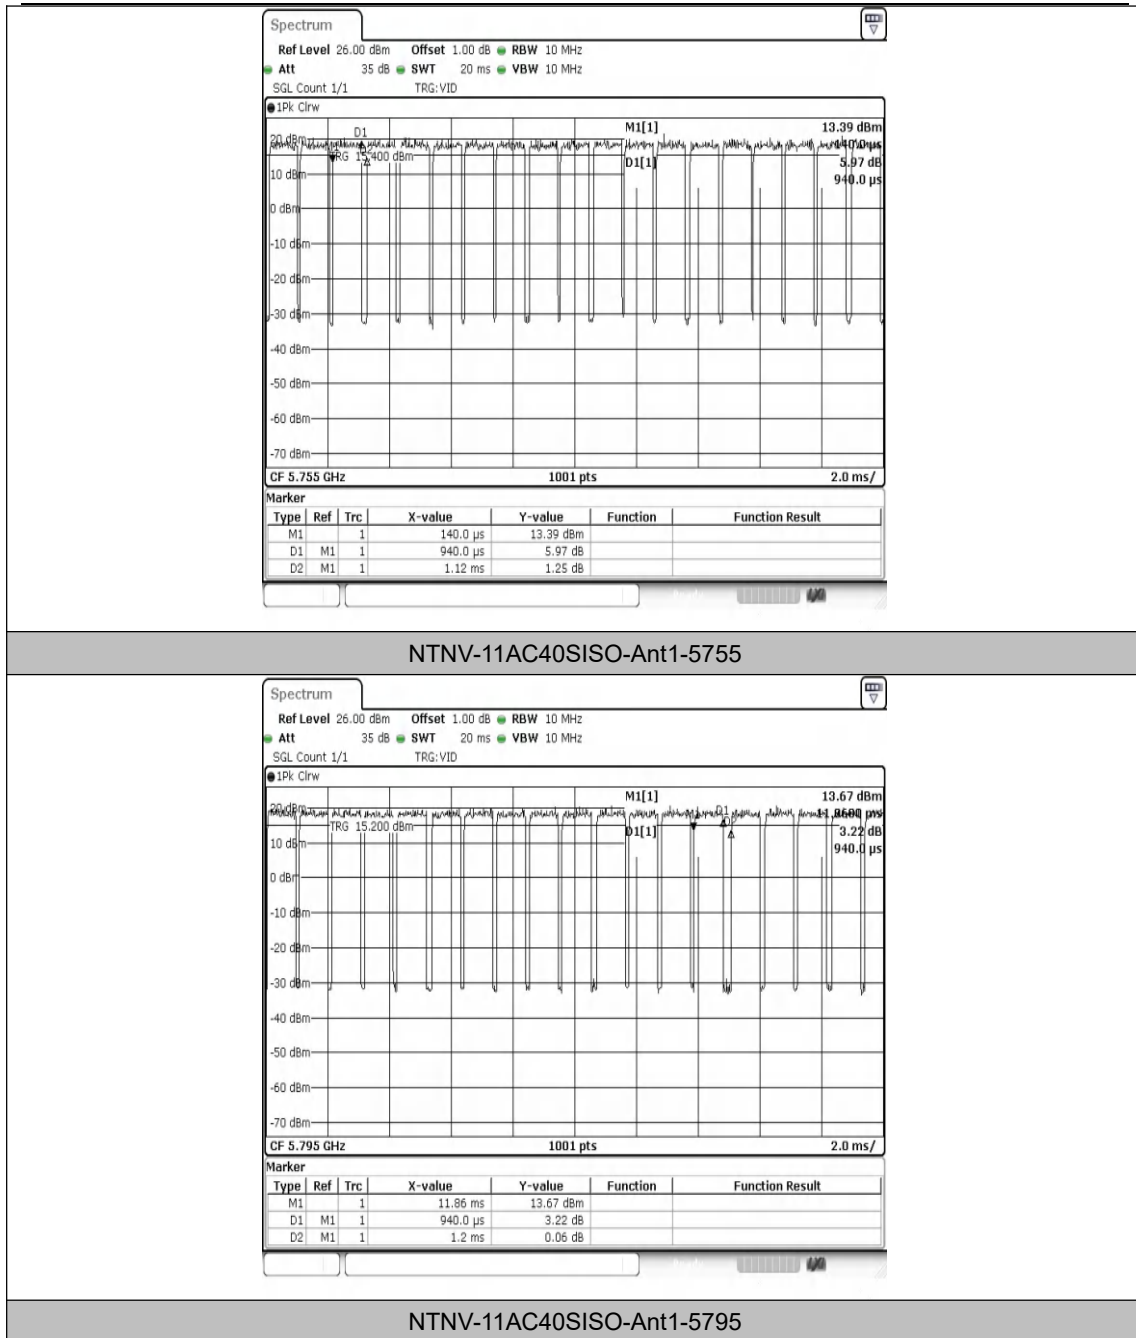

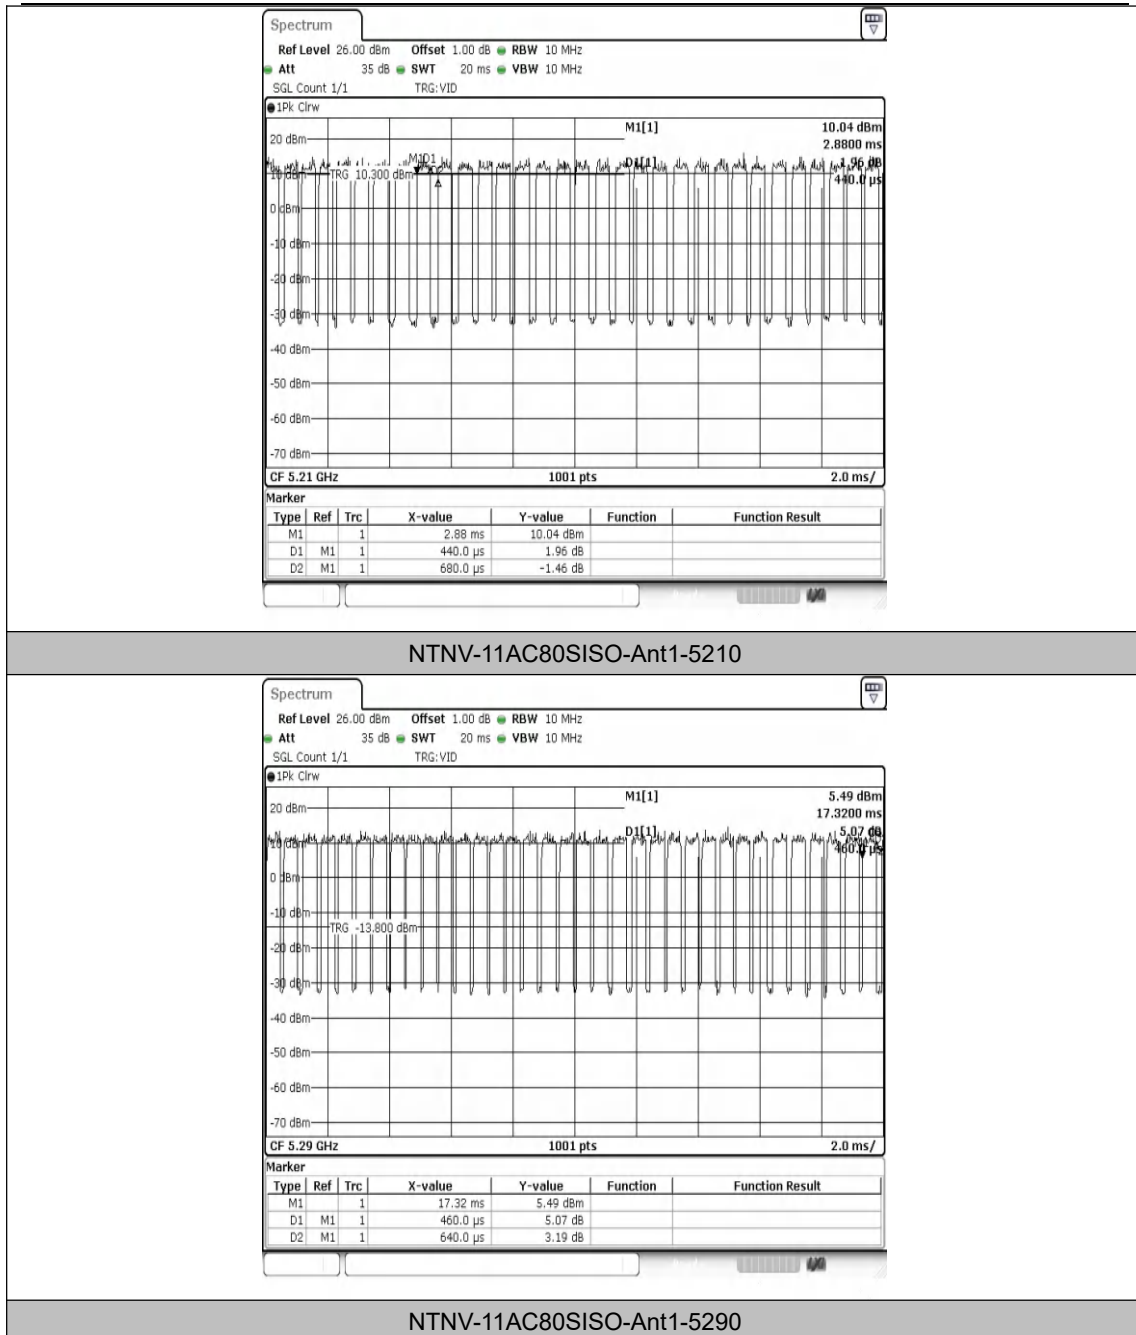

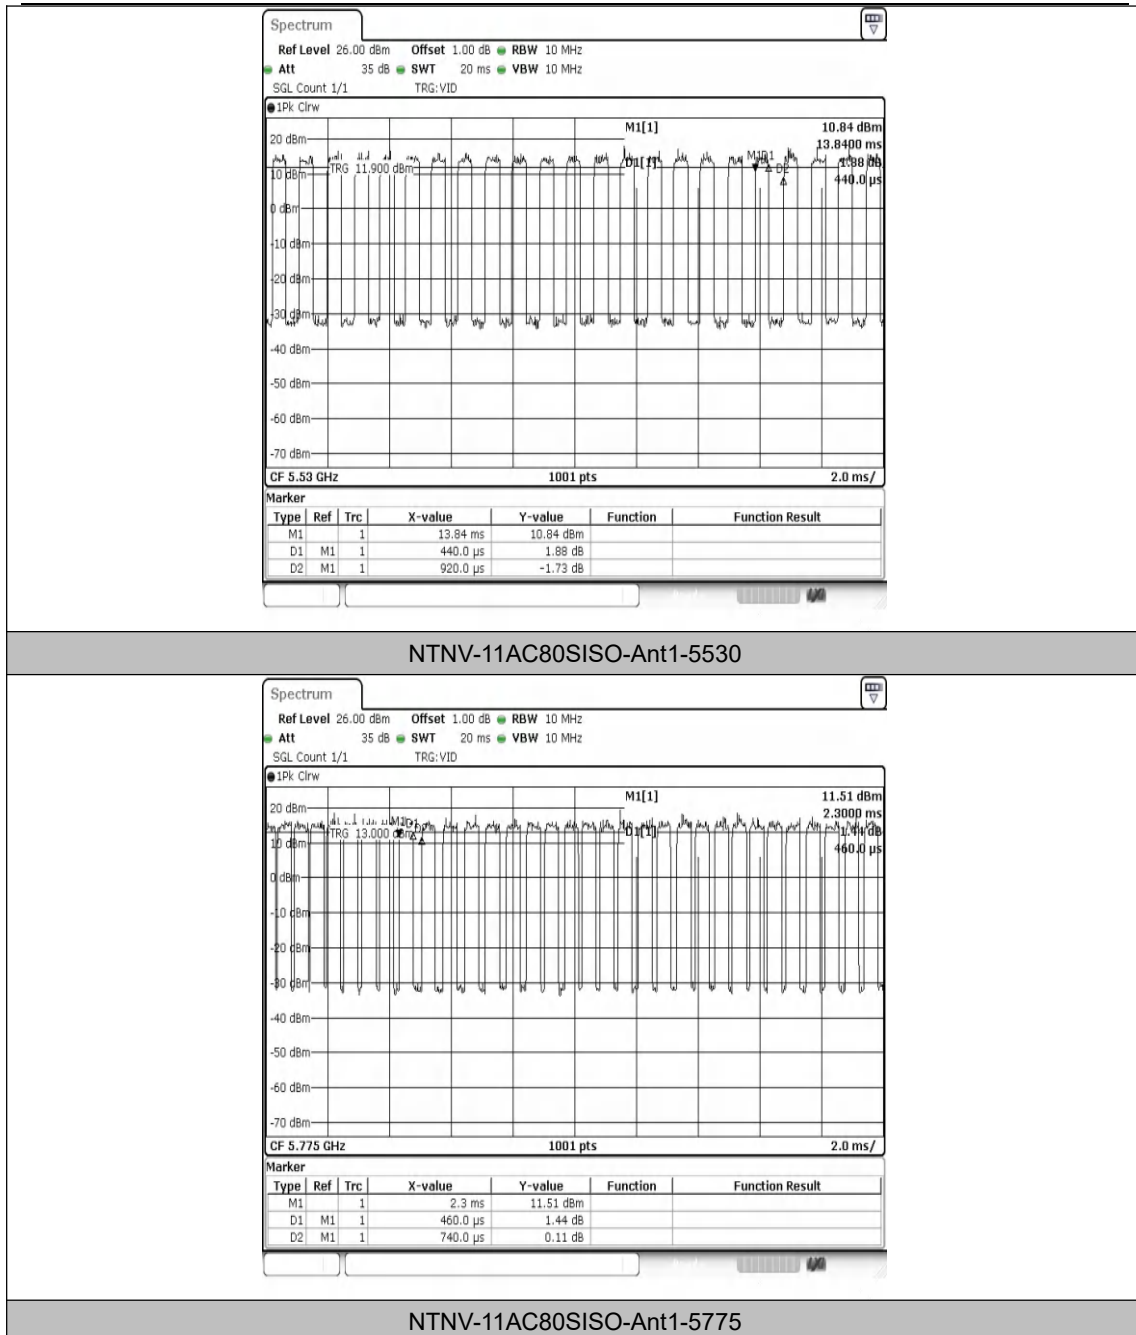

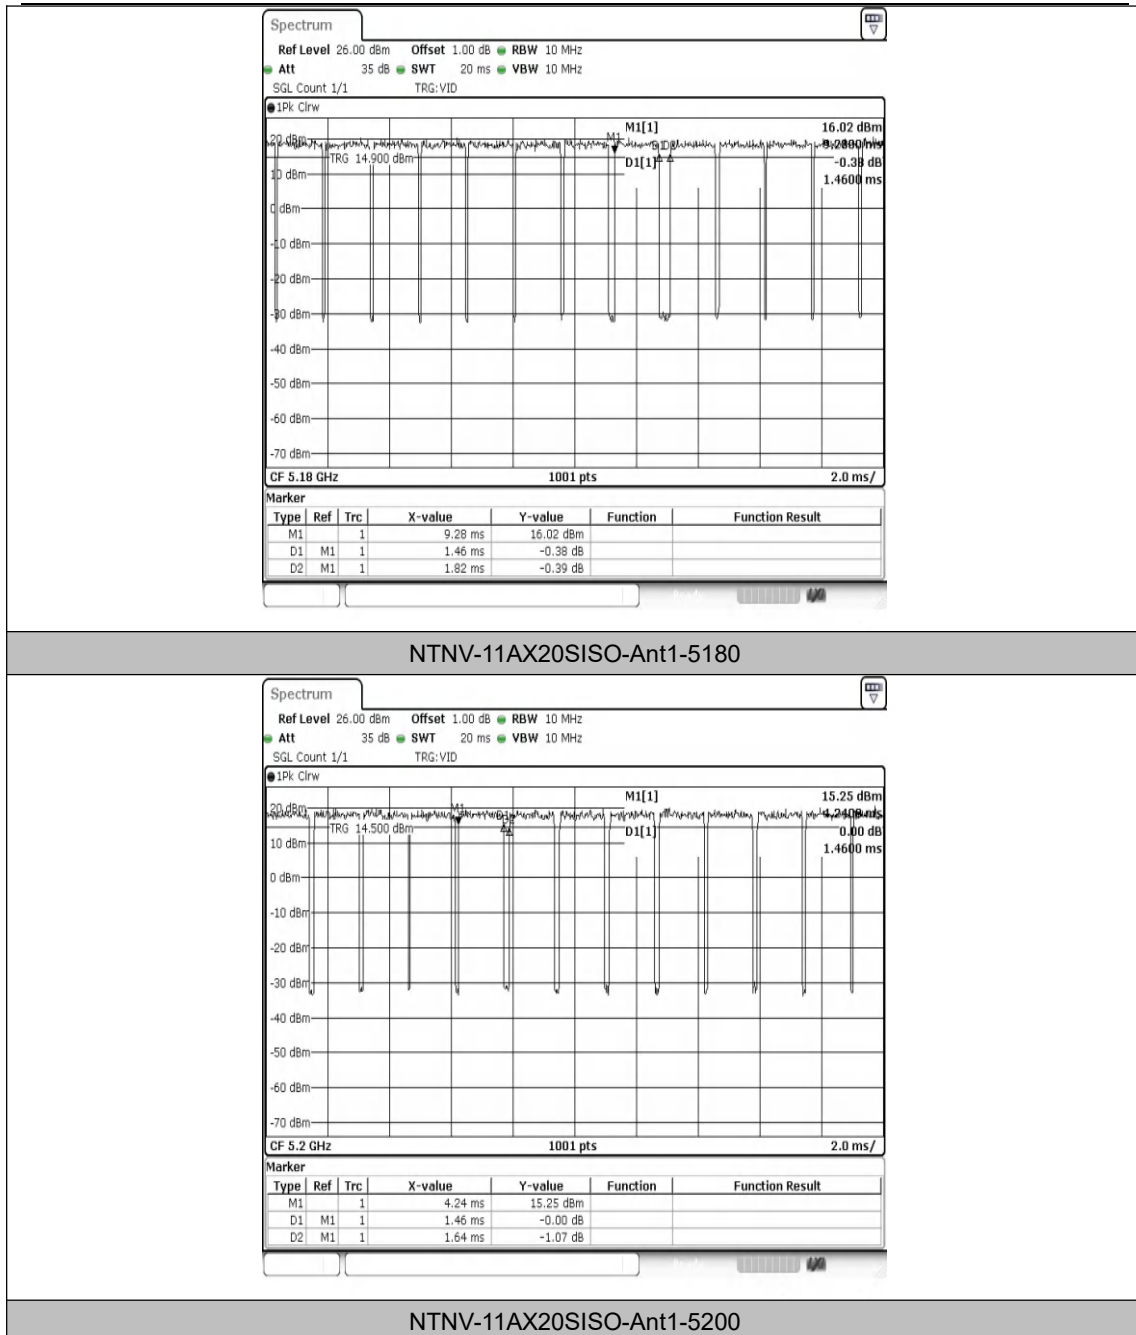

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotek.com

Hotline
400-003-0500
www.anbotek.com

