

Appendix Test Data

Report No.:	1813C50260012503	Test Sample No.:	1-2-2
Start Test Date:	2025-6-13	Finish Test Date:	2025-6-17
Test Engineer:	<i>dylan. Ma</i>	Auditor:	<i>Justin Feng</i>
Temperature:	26.2°C	Relative Humidity:	56%
Pressure:	101kPa		

Appendix A1: 26dB Bandwidth

Test Result

Test Mode	Antenna	Frequency[MHz]	26db EBW [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5180	23.16	5167.24	5190.40	---	---
11A	Ant1	5200	23.52	5187.80	5211.32	---	---
11A	Ant1	5240	21.16	5229.72	5250.88	---	---
11A	Ant1	5260	22.52	5248.04	5270.56	---	---
11A	Ant1	5280	22.04	5268.84	5290.88	---	---
11A	Ant1	5320	22.60	5308.32	5330.92	---	---
11A	Ant1	5500	22.96	5488.40	5511.36	---	---
11A	Ant1	5580	23.00	5568.12	5591.12	---	---
11A	Ant1	5700	23.28	5688.64	5711.92	---	---
11A	Ant1	5745	23.00	5733.84	5756.84	---	---
11A	Ant1	5785	23.08	5773.16	5796.24	---	---
11A	Ant1	5825	24.28	5812.60	5836.88	---	---
11N20SISO	Ant1	5180	24.60	5168.08	5192.68	---	---
11N20SISO	Ant1	5200	23.48	5187.76	5211.24	---	---
11N20SISO	Ant1	5240	22.72	5228.44	5251.16	---	---
11N20SISO	Ant1	5260	24.68	5247.64	5272.32	---	---
11N20SISO	Ant1	5280	23.56	5267.88	5291.44	---	---
11N20SISO	Ant1	5320	22.16	5308.52	5330.68	---	---
11N20SISO	Ant1	5500	23.44	5488.32	5511.76	---	---
11N20SISO	Ant1	5580	24.72	5568.52	5593.24	---	---
11N20SISO	Ant1	5700	23.00	5688.44	5711.44	---	---
11N20SISO	Ant1	5745	25.40	5732.40	5757.80	---	---
11N20SISO	Ant1	5785	23.04	5773.72	5796.76	---	---
11N20SISO	Ant1	5825	23.44	5813.08	5836.52	---	---
11N40SISO	Ant1	5190	43.28	5167.84	5211.12	---	---

11N40SISO	Ant1	5230	43.28	5209.28	5252.56	---	---
11N40SISO	Ant1	5270	45.04	5246.72	5291.76	---	---
11N40SISO	Ant1	5310	43.20	5289.20	5332.40	---	---
11N40SISO	Ant1	5510	42.48	5488.72	5531.20	---	---
11N40SISO	Ant1	5550	49.12	5526.72	5575.84	---	---
11N40SISO	Ant1	5670	45.76	5646.72	5692.48	---	---
11N40SISO	Ant1	5755	44.48	5732.68	5777.16	---	---
11N40SISO	Ant1	5795	44.88	5773.72	5818.60	---	---
11AC20SISO	Ant1	5180	23.12	5168.36	5191.48	---	---
11AC20SISO	Ant1	5200	23.36	5188.20	5211.56	---	---
11AC20SISO	Ant1	5240	23.28	5227.96	5251.24	---	---
11AC20SISO	Ant1	5260	23.68	5247.68	5271.36	---	---
11AC20SISO	Ant1	5280	24.52	5268.16	5292.68	---	---
11AC20SISO	Ant1	5320	22.72	5309.00	5331.72	---	---
11AC20SISO	Ant1	5500	23.64	5487.88	5511.52	---	---
11AC20SISO	Ant1	5580	24.64	5567.96	5592.60	---	---
11AC20SISO	Ant1	5700	24.48	5688.04	5712.52	---	---
11AC20SISO	Ant1	5745	23.72	5733.84	5757.56	---	---
11AC20SISO	Ant1	5785	23.44	5773.56	5797.00	---	---
11AC20SISO	Ant1	5825	24.72	5813.68	5838.40	---	---
11AC40SISO	Ant1	5190	43.44	5168.16	5211.60	---	---
11AC40SISO	Ant1	5230	45.28	5207.04	5252.32	---	---
11AC40SISO	Ant1	5270	45.20	5248.32	5293.52	---	---
11AC40SISO	Ant1	5310	42.32	5289.12	5331.44	---	---
11AC40SISO	Ant1	5510	44.96	5487.84	5532.80	---	---
11AC40SISO	Ant1	5550	45.76	5527.68	5573.44	---	---
11AC40SISO	Ant1	5670	43.12	5648.80	5691.92	---	---
11AC40SISO	Ant1	5755	44.32	5732.76	5777.08	---	---
11AC40SISO	Ant1	5795	46.48	5772.12	5818.60	---	---
11AC80SISO	Ant1	5210	86.40	5166.00	5252.40	---	---
11AC80SISO	Ant1	5290	85.44	5246.96	5332.40	---	---
11AC80SISO	Ant1	5530	84.48	5487.44	5571.92	---	---
11AC80SISO	Ant1	5775	86.24	5733.72	5819.96	---	---
11AX20SISO	Ant1	5180	22.76	5169.32	5192.08	---	---
11AX20SISO	Ant1	5200	23.60	5187.68	5211.28	---	---
11AX20SISO	Ant1	5240	22.52	5229.08	5251.60	---	---
11AX20SISO	Ant1	5260	22.16	5248.20	5270.36	---	---
11AX20SISO	Ant1	5280	23.92	5268.12	5292.04	---	---
11AX20SISO	Ant1	5320	23.04	5307.84	5330.88	---	---
11AX20SISO	Ant1	5500	23.56	5488.24	5511.80	---	---
11AX20SISO	Ant1	5580	21.80	5568.88	5590.68	---	---
11AX20SISO	Ant1	5700	25.68	5687.28	5712.96	---	---


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

11AX20SISO	Ant1	5745	24.24	5732.48	5756.72	---	---
11AX20SISO	Ant1	5785	23.76	5773.60	5797.36	---	---
11AX20SISO	Ant1	5825	23.08	5813.00	5836.08	---	---
11AX40SISO	Ant1	5190	43.52	5168.00	5211.52	---	---
11AX40SISO	Ant1	5230	42.56	5207.68	5250.24	---	---
11AX40SISO	Ant1	5270	42.80	5247.04	5289.84	---	---
11AX40SISO	Ant1	5310	41.84	5288.24	5330.08	---	---
11AX40SISO	Ant1	5510	42.56	5488.88	5531.44	---	---
11AX40SISO	Ant1	5550	43.04	5528.64	5571.68	---	---
11AX40SISO	Ant1	5670	43.84	5648.16	5692.00	---	---
11AX40SISO	Ant1	5755	41.68	5734.04	5775.72	---	---
11AX40SISO	Ant1	5795	44.48	5773.00	5817.48	---	---
11AX80SISO	Ant1	5210	82.40	5167.76	5250.16	---	---
11AX80SISO	Ant1	5290	83.04	5247.28	5330.32	---	---
11AX80SISO	Ant1	5530	86.72	5485.68	5572.40	---	---
11AX80SISO	Ant1	5775	85.92	5733.88	5819.80	---	---


Test Graphs

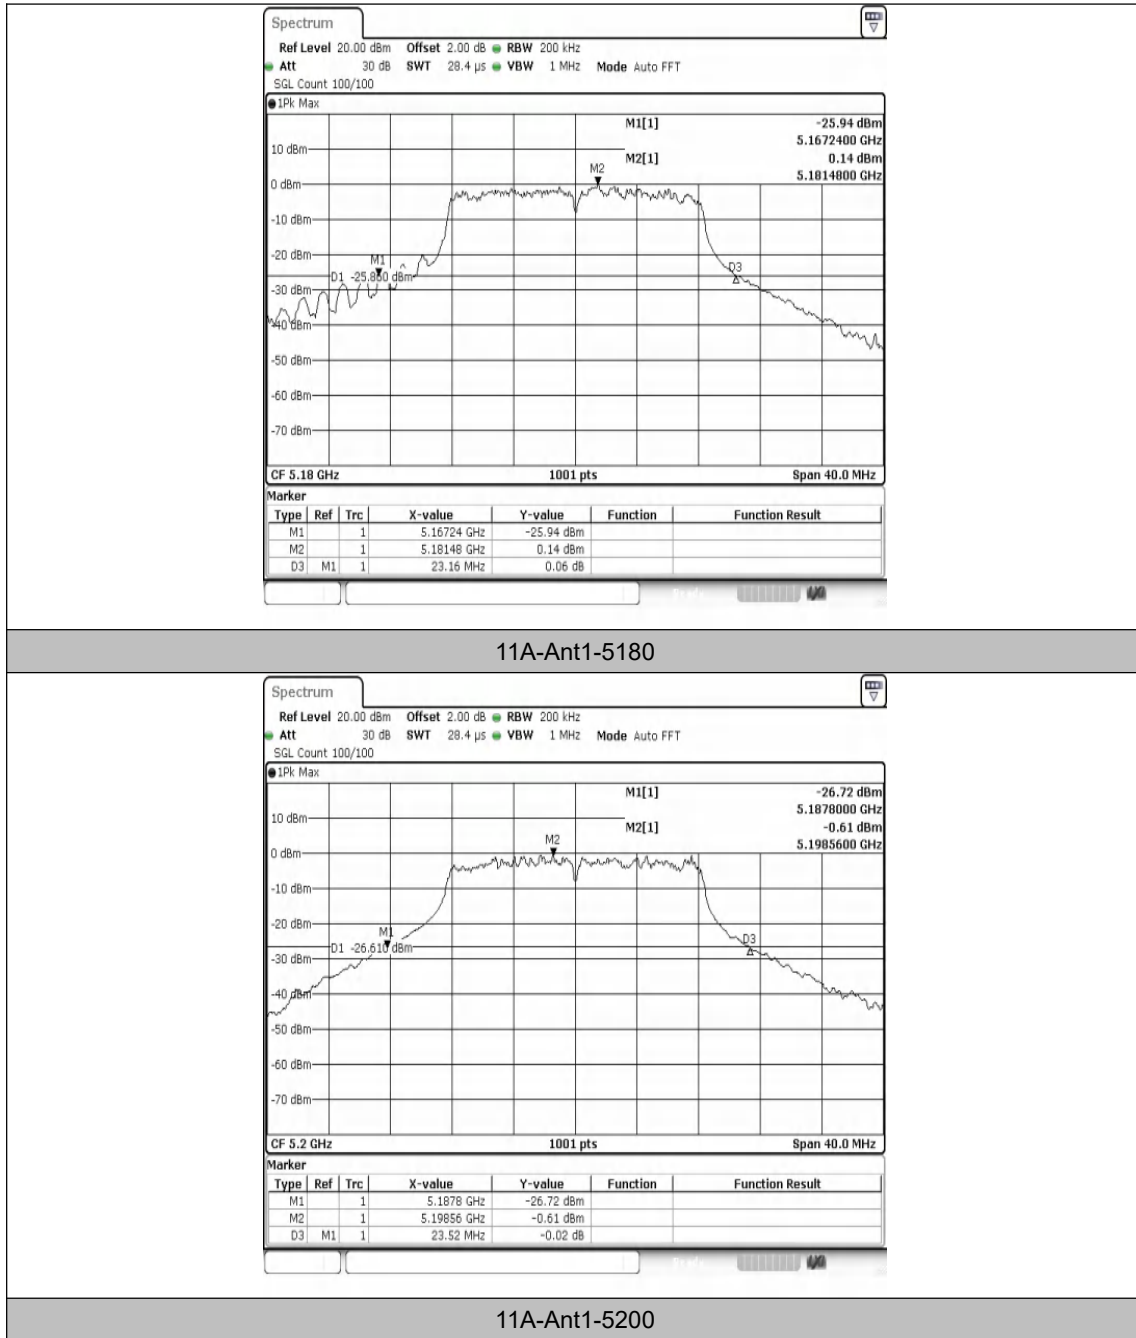



Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

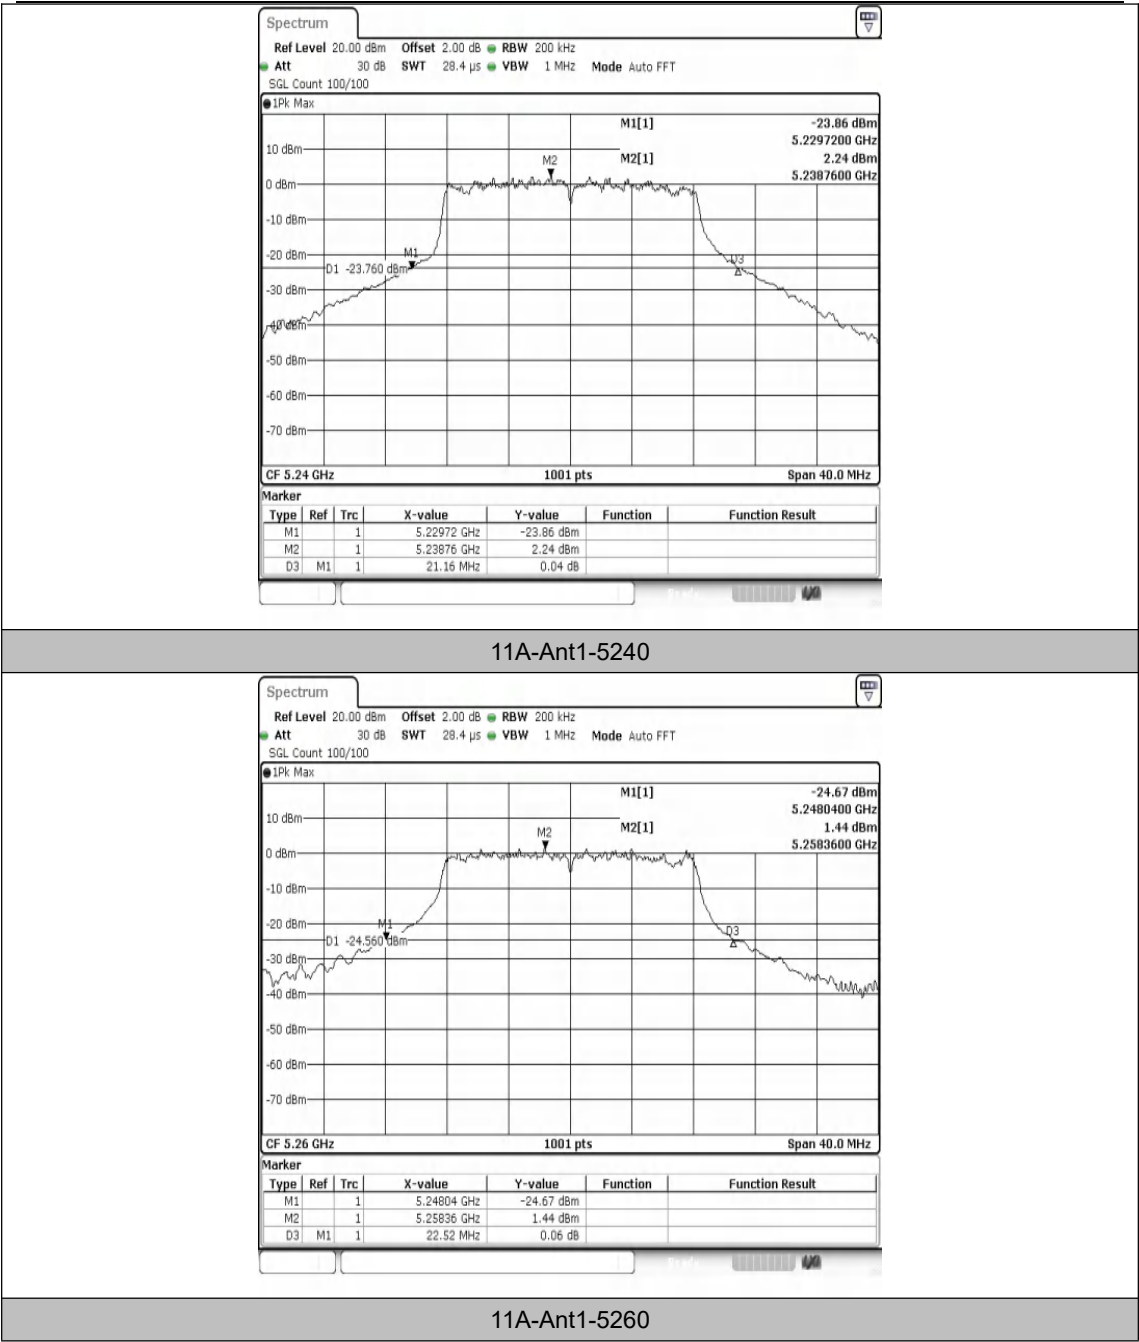


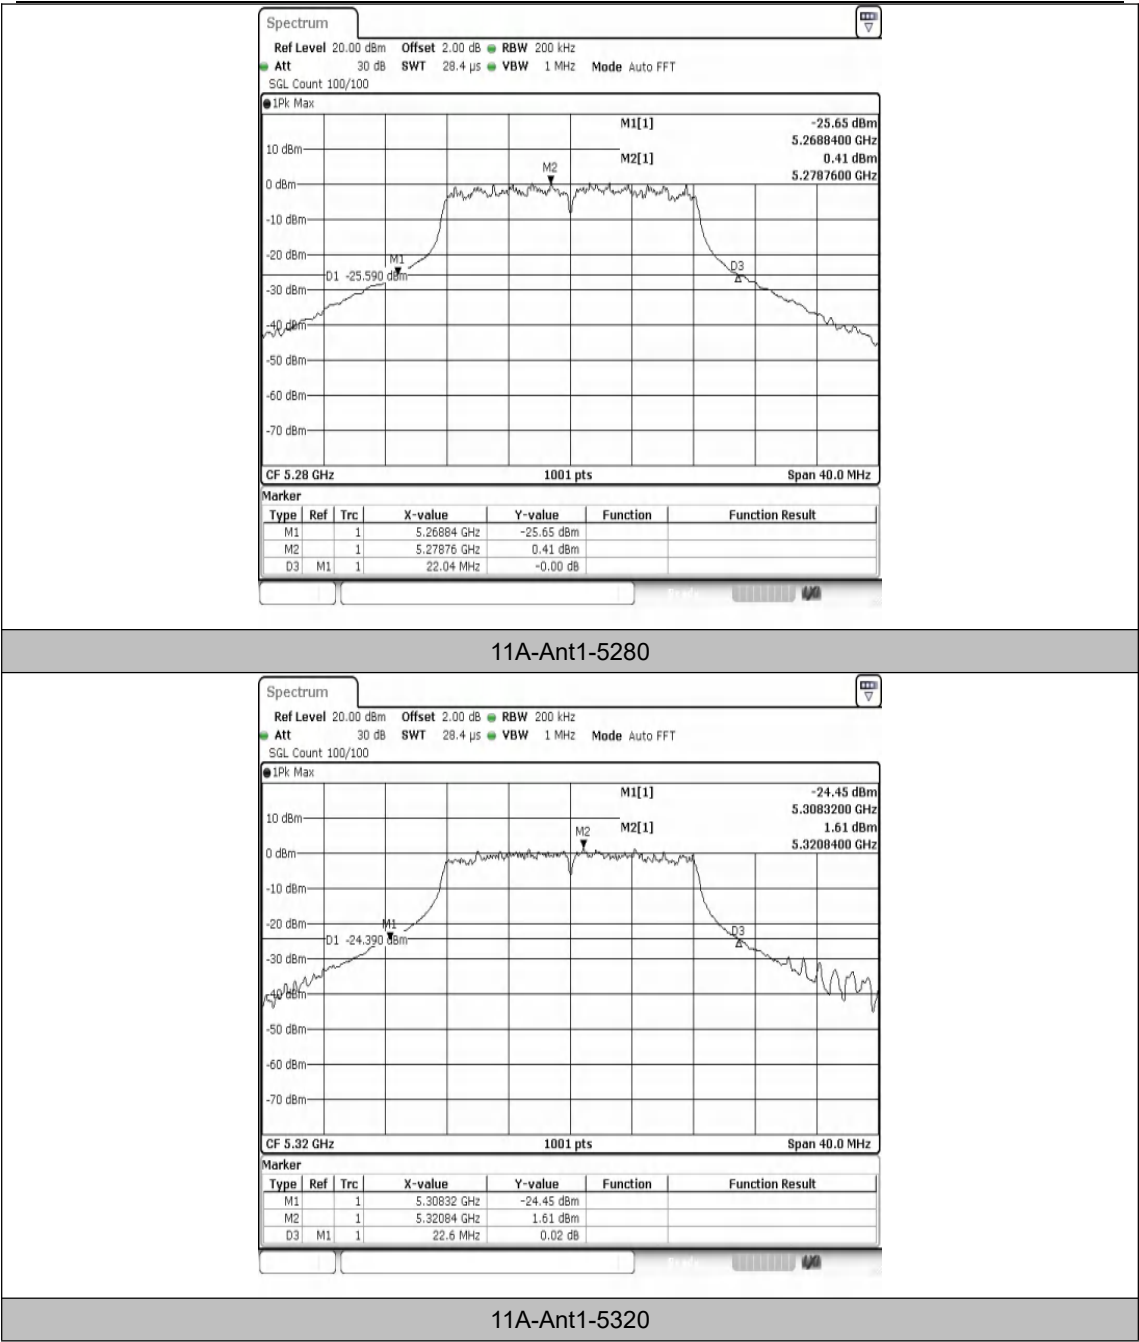


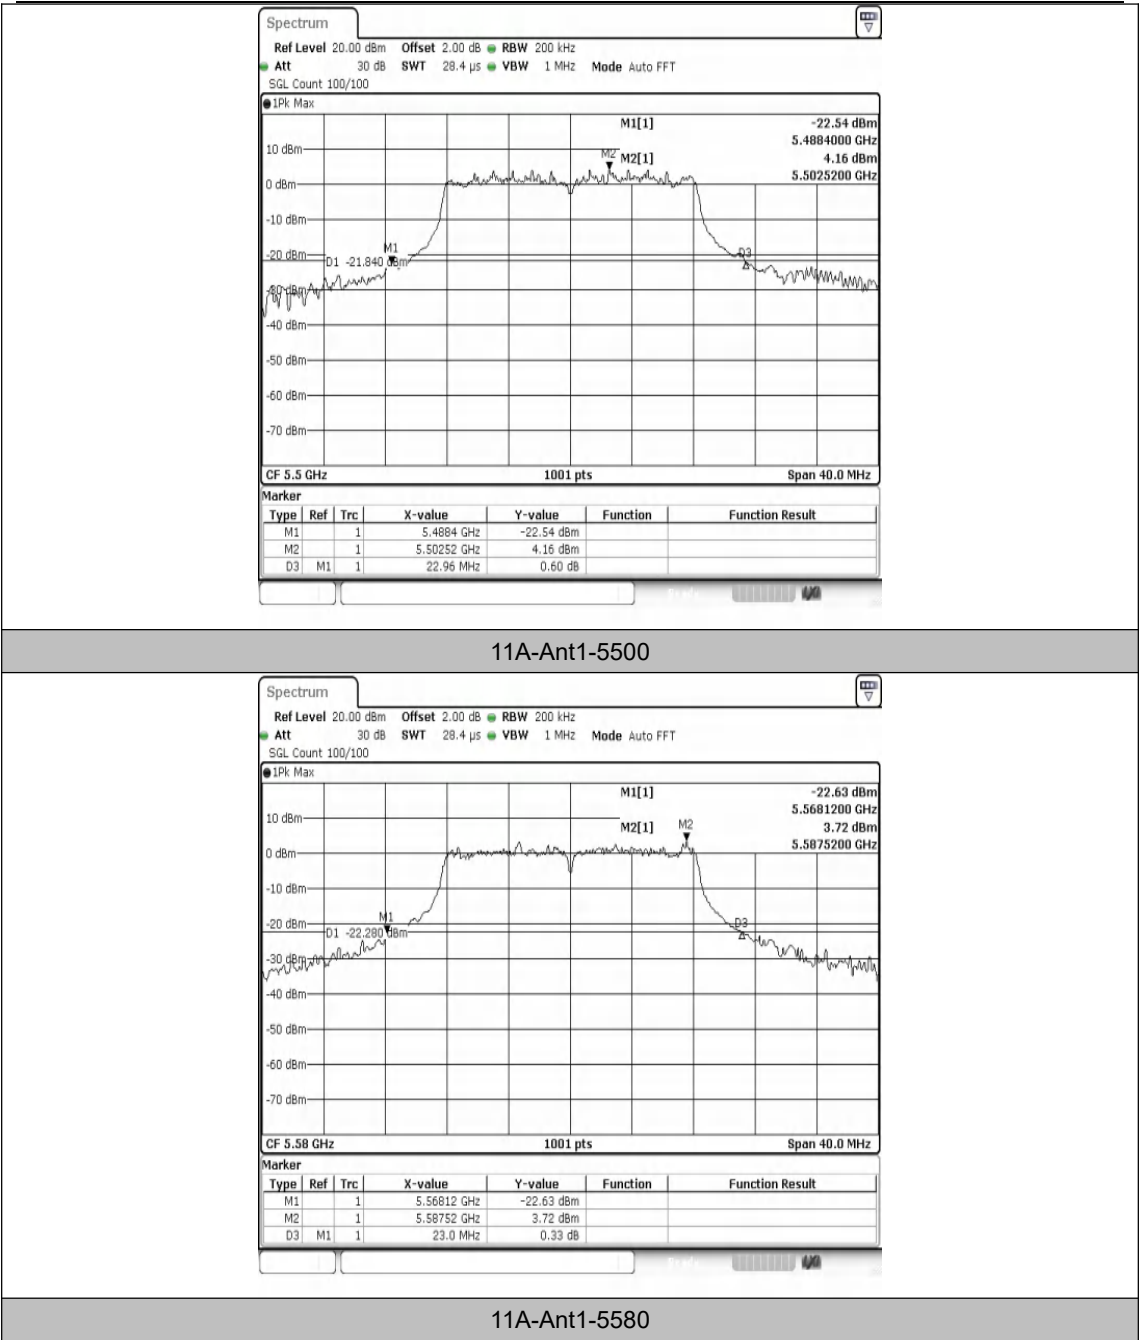


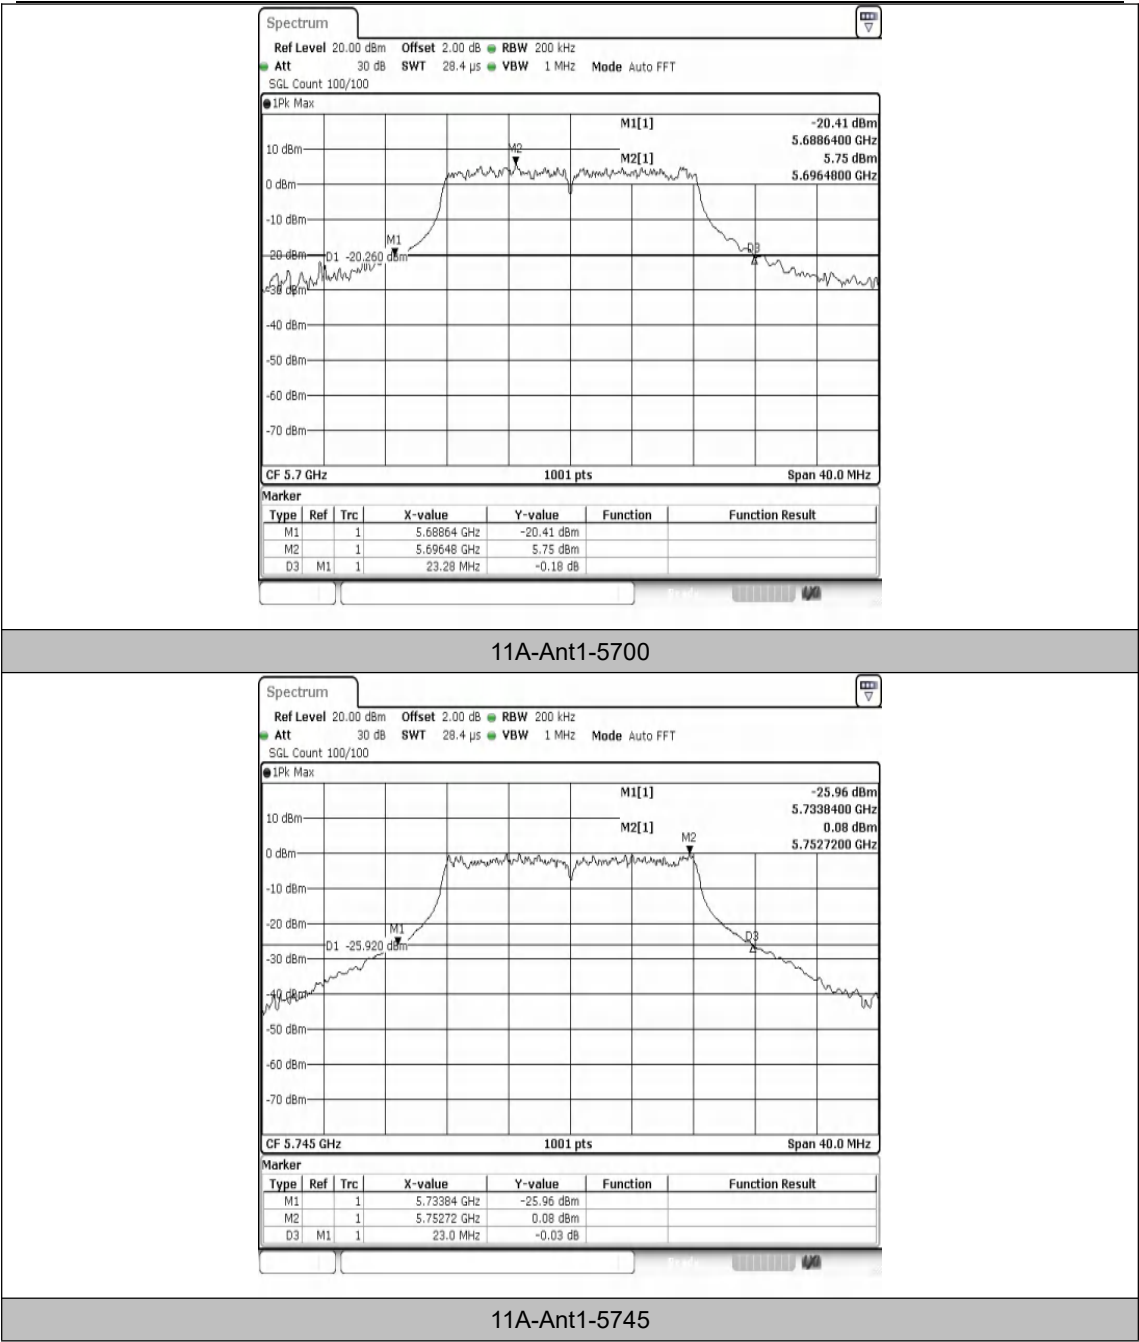


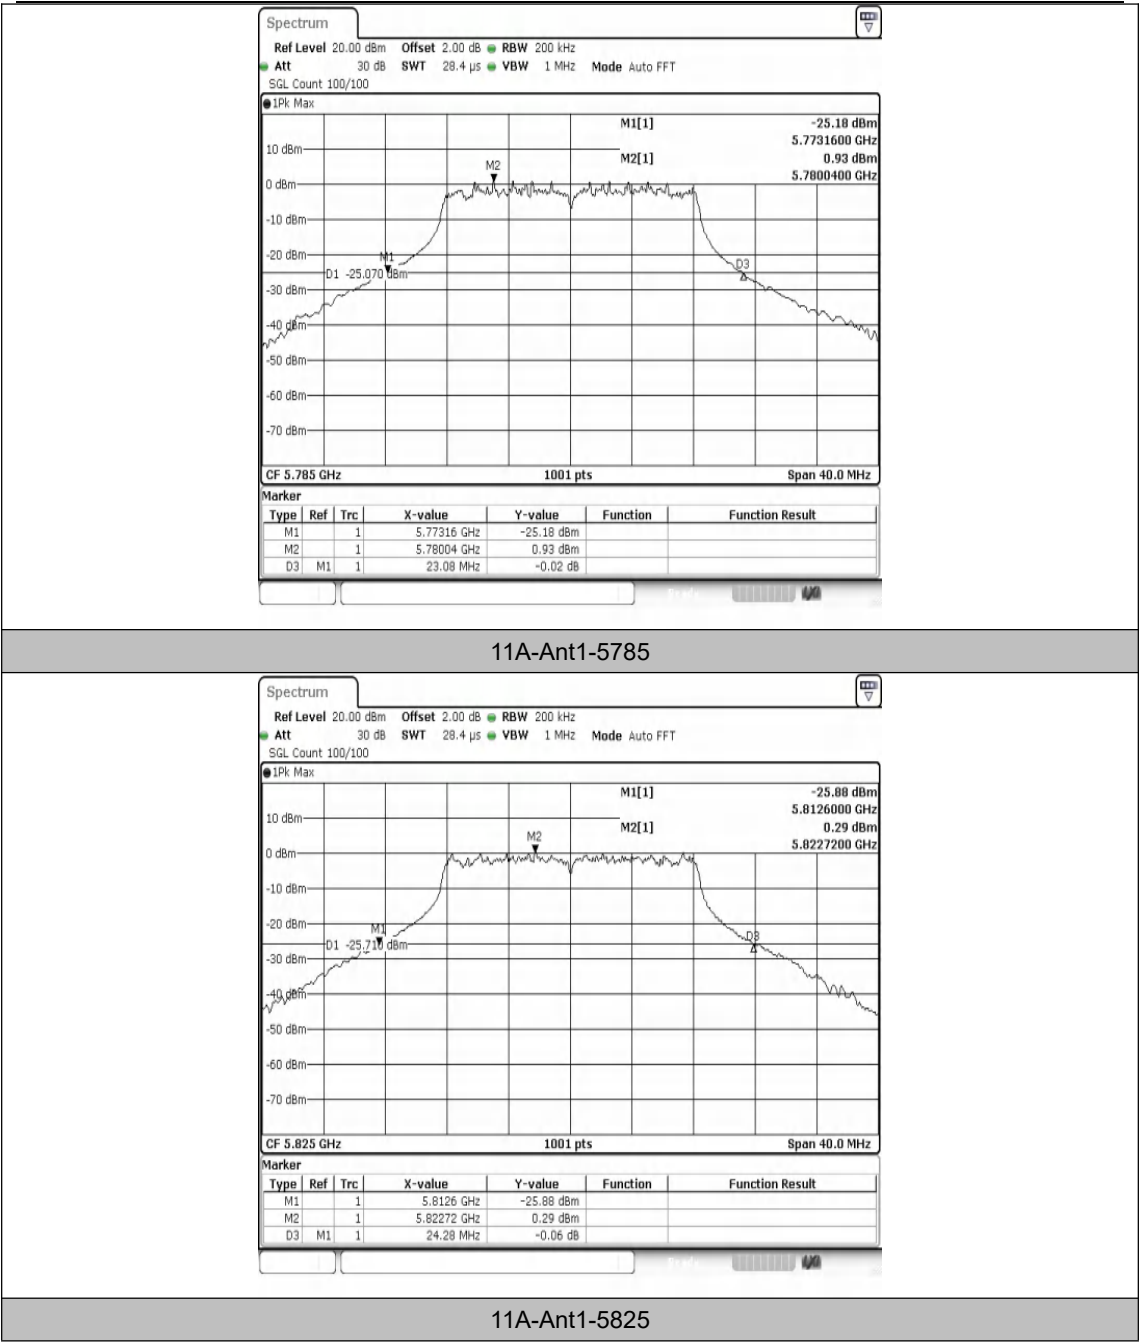


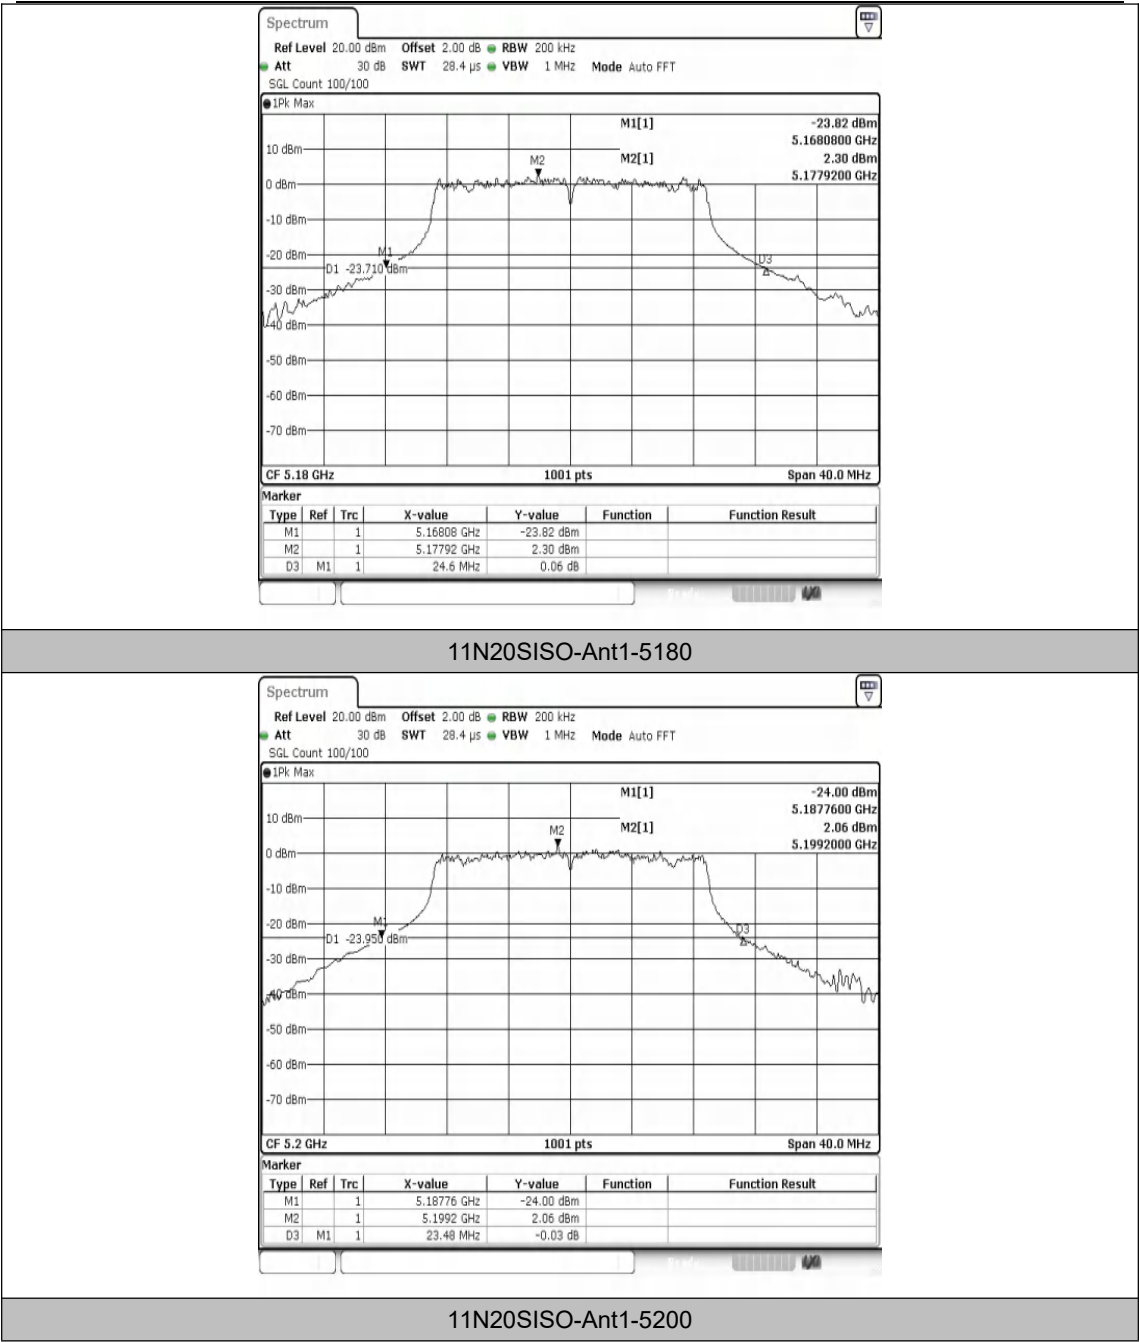

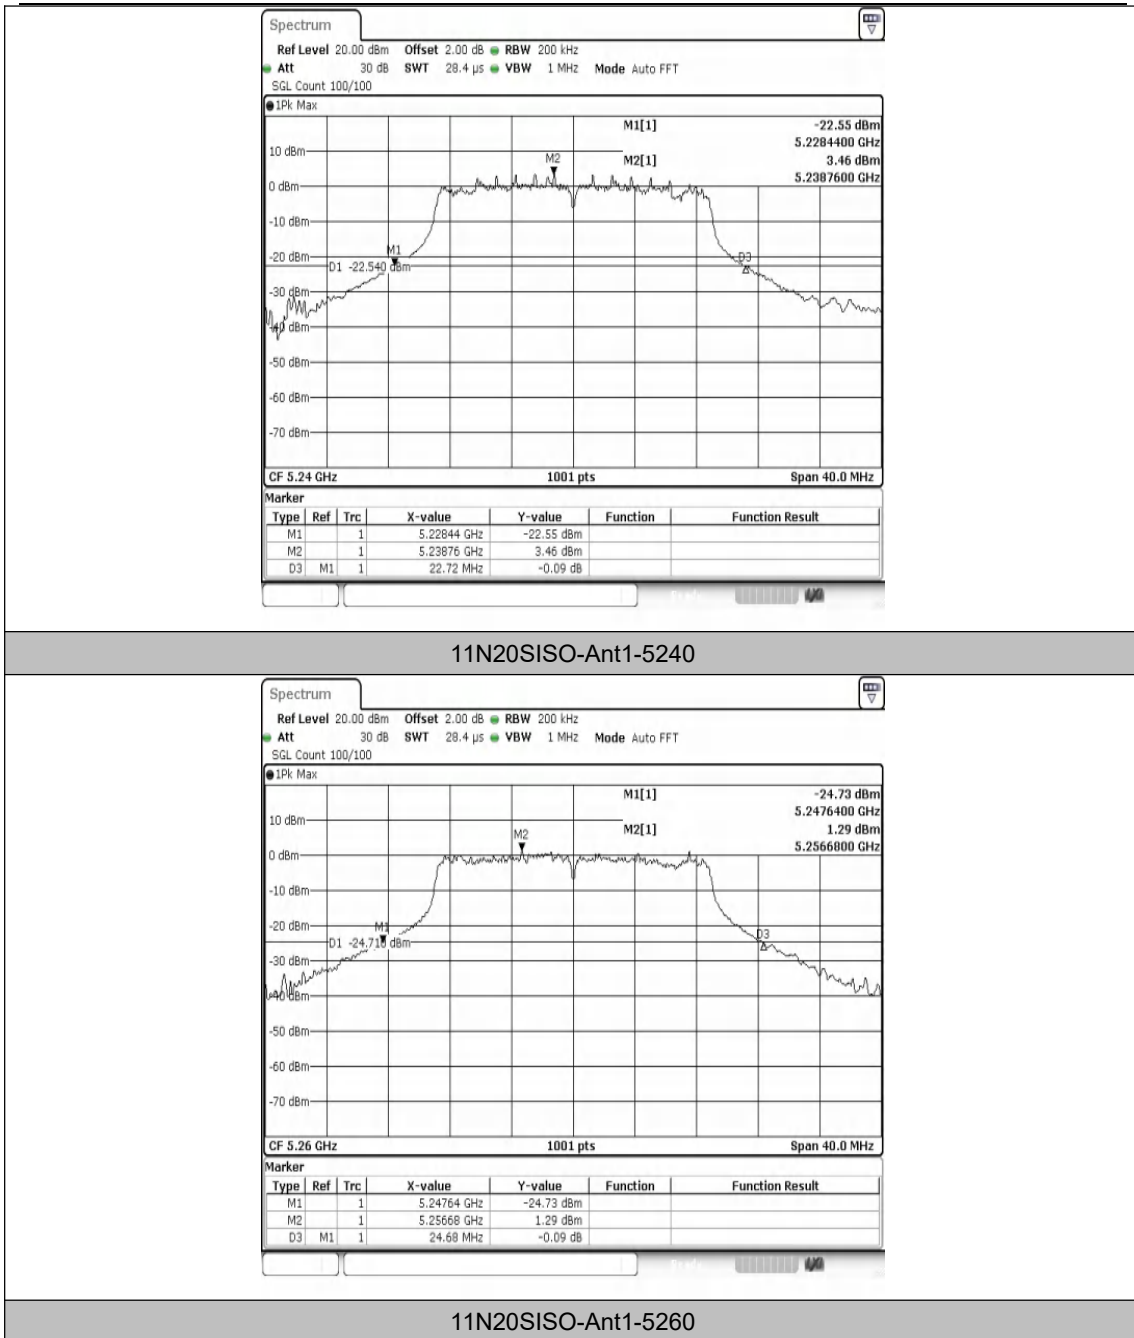

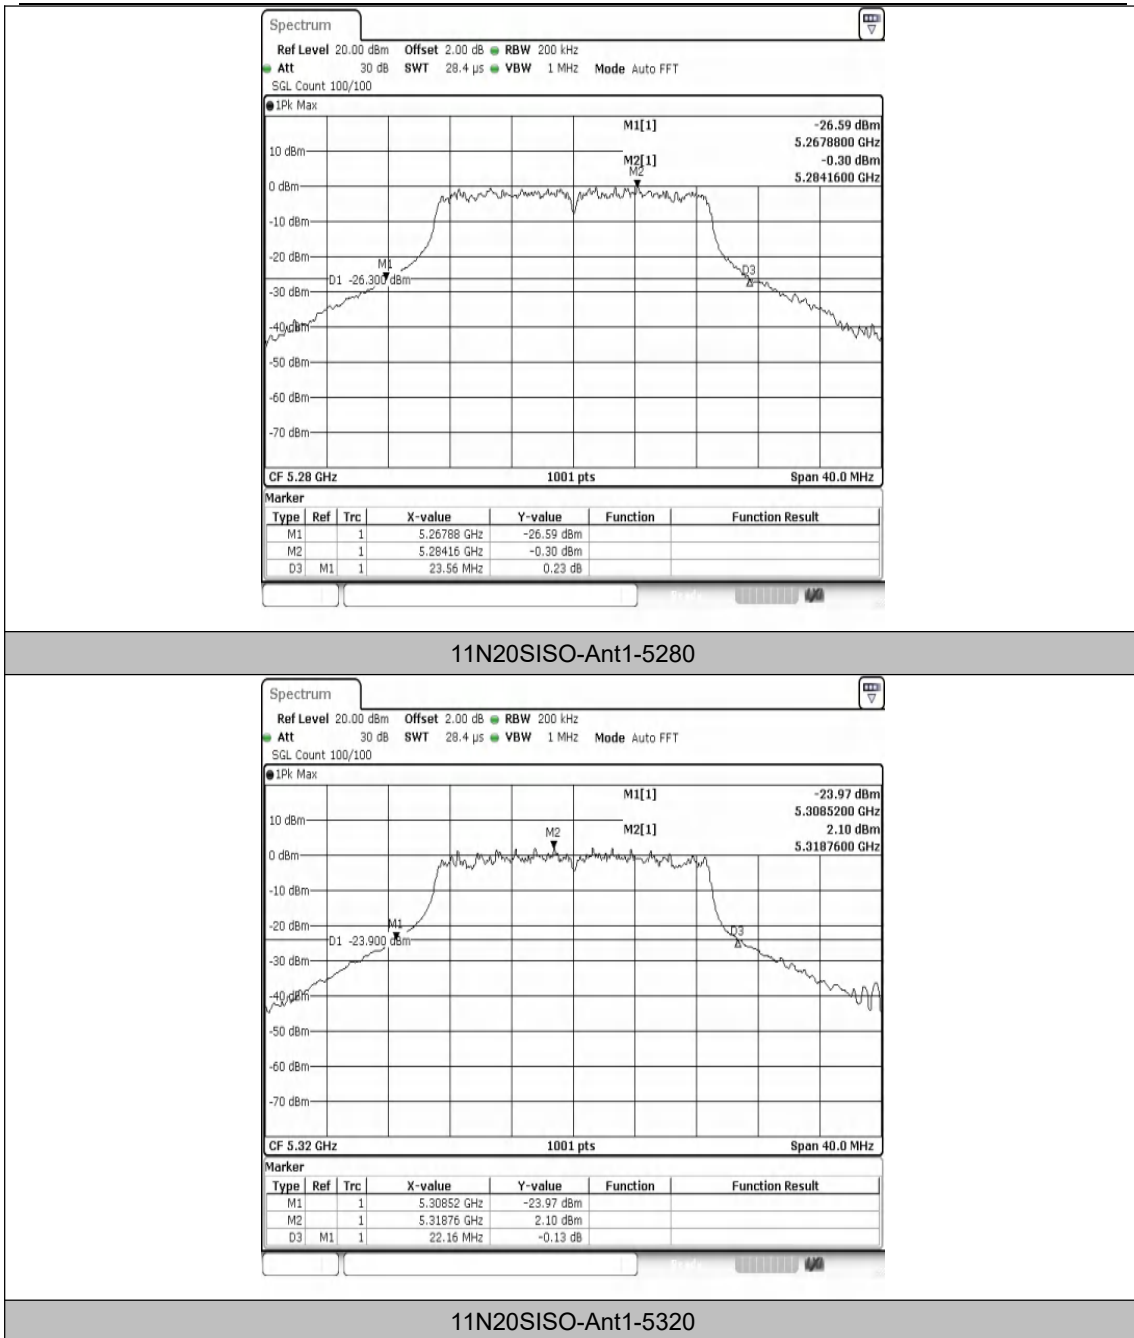

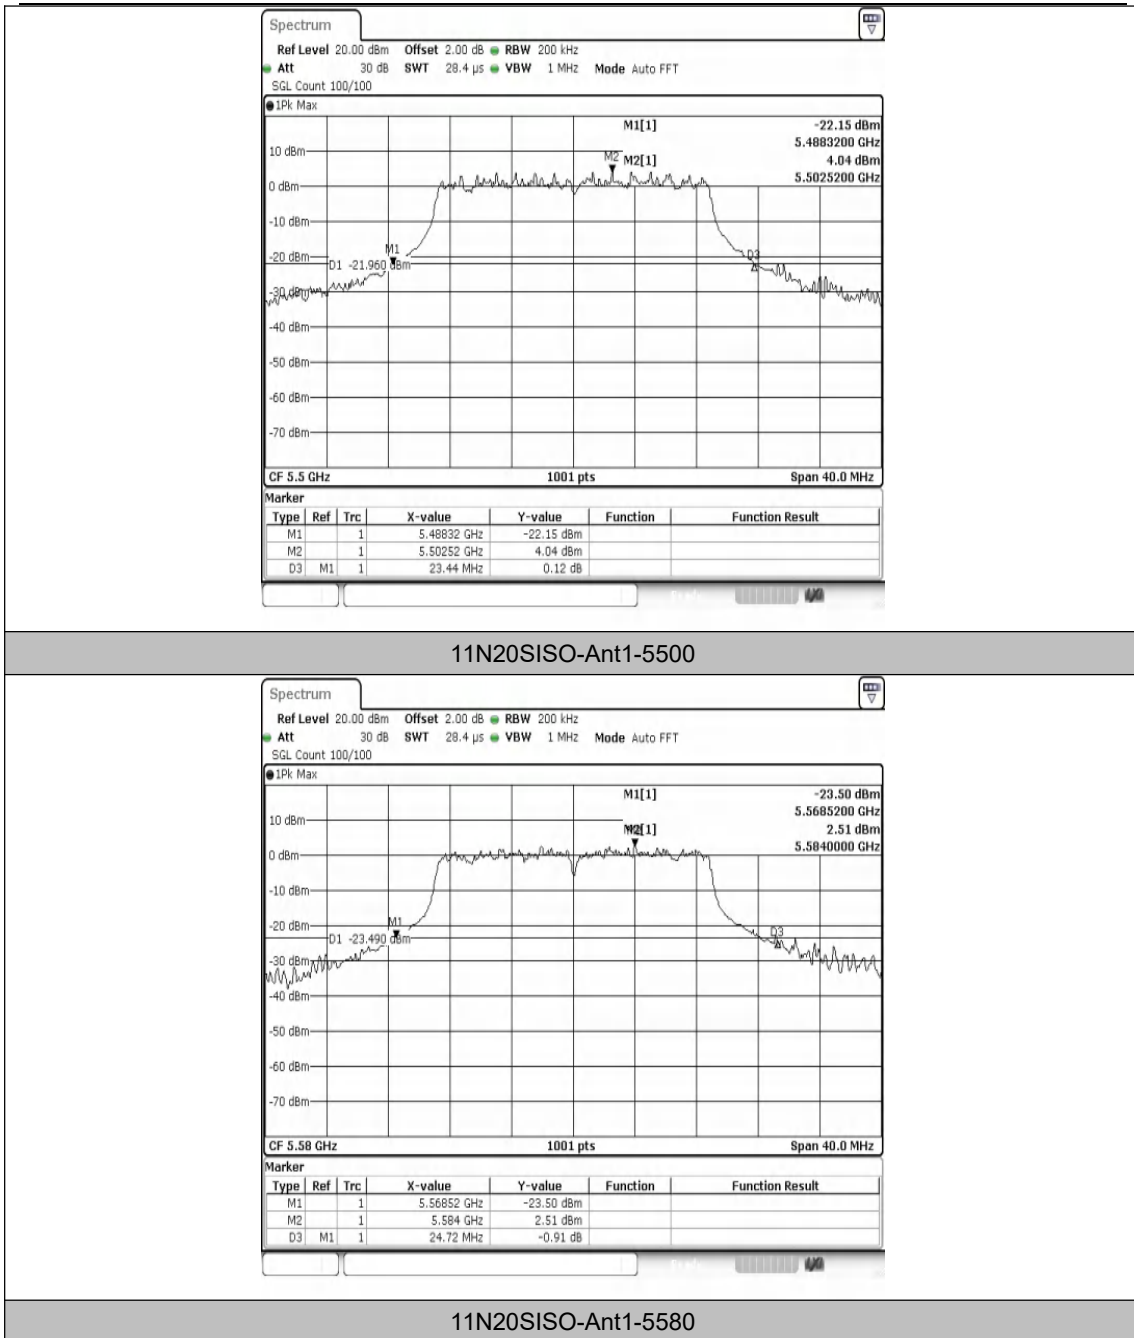


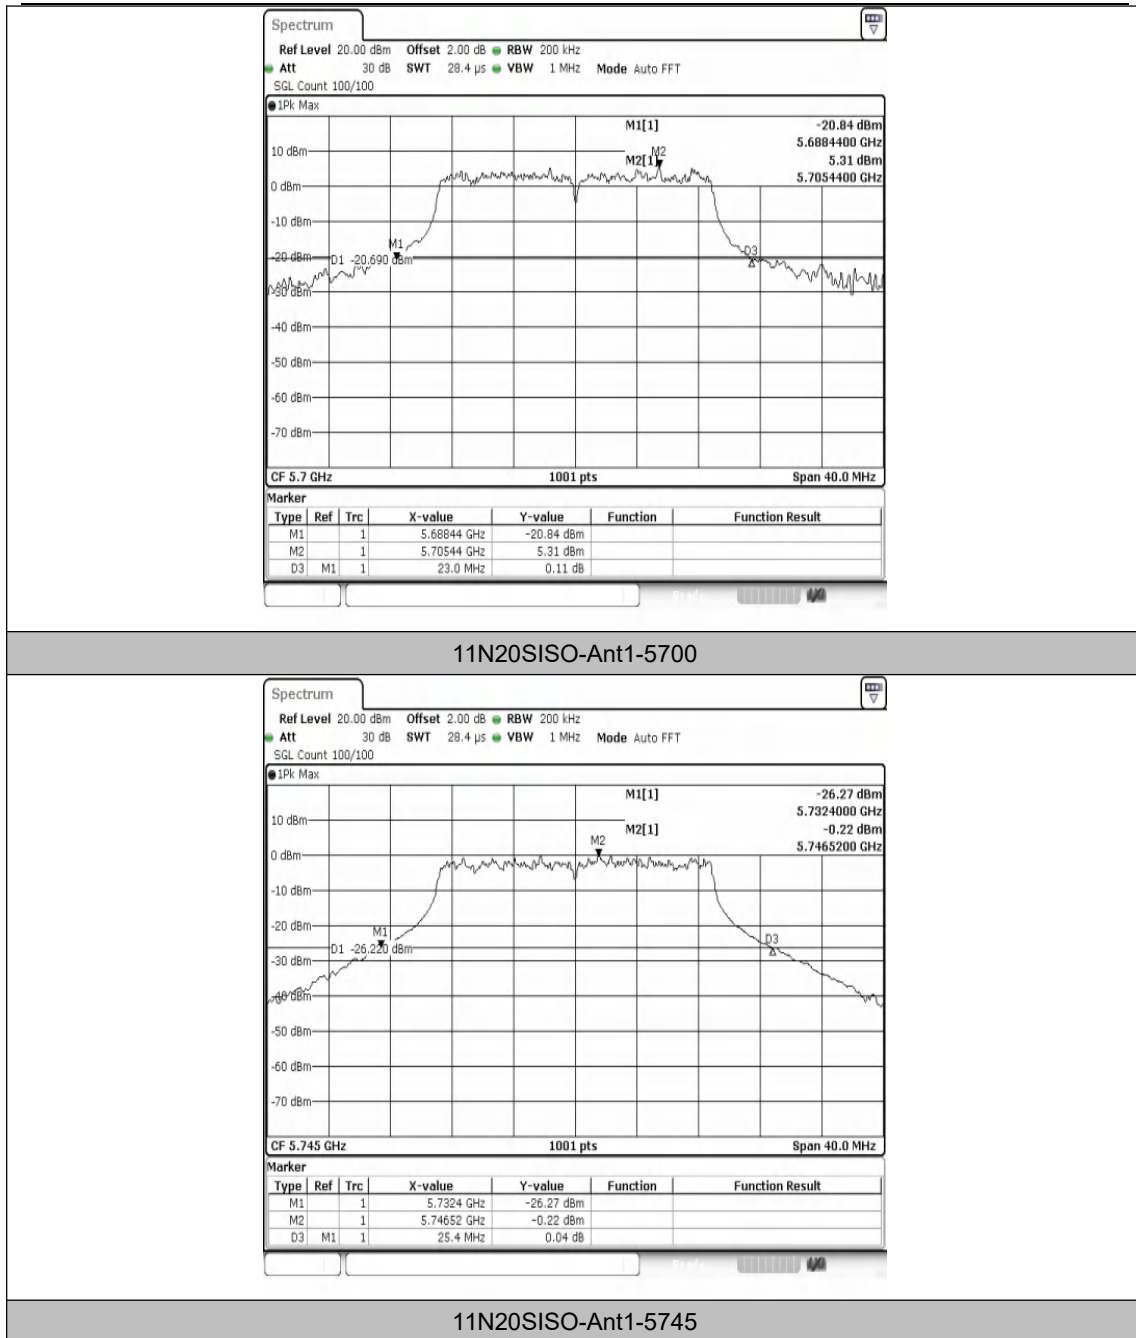



Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

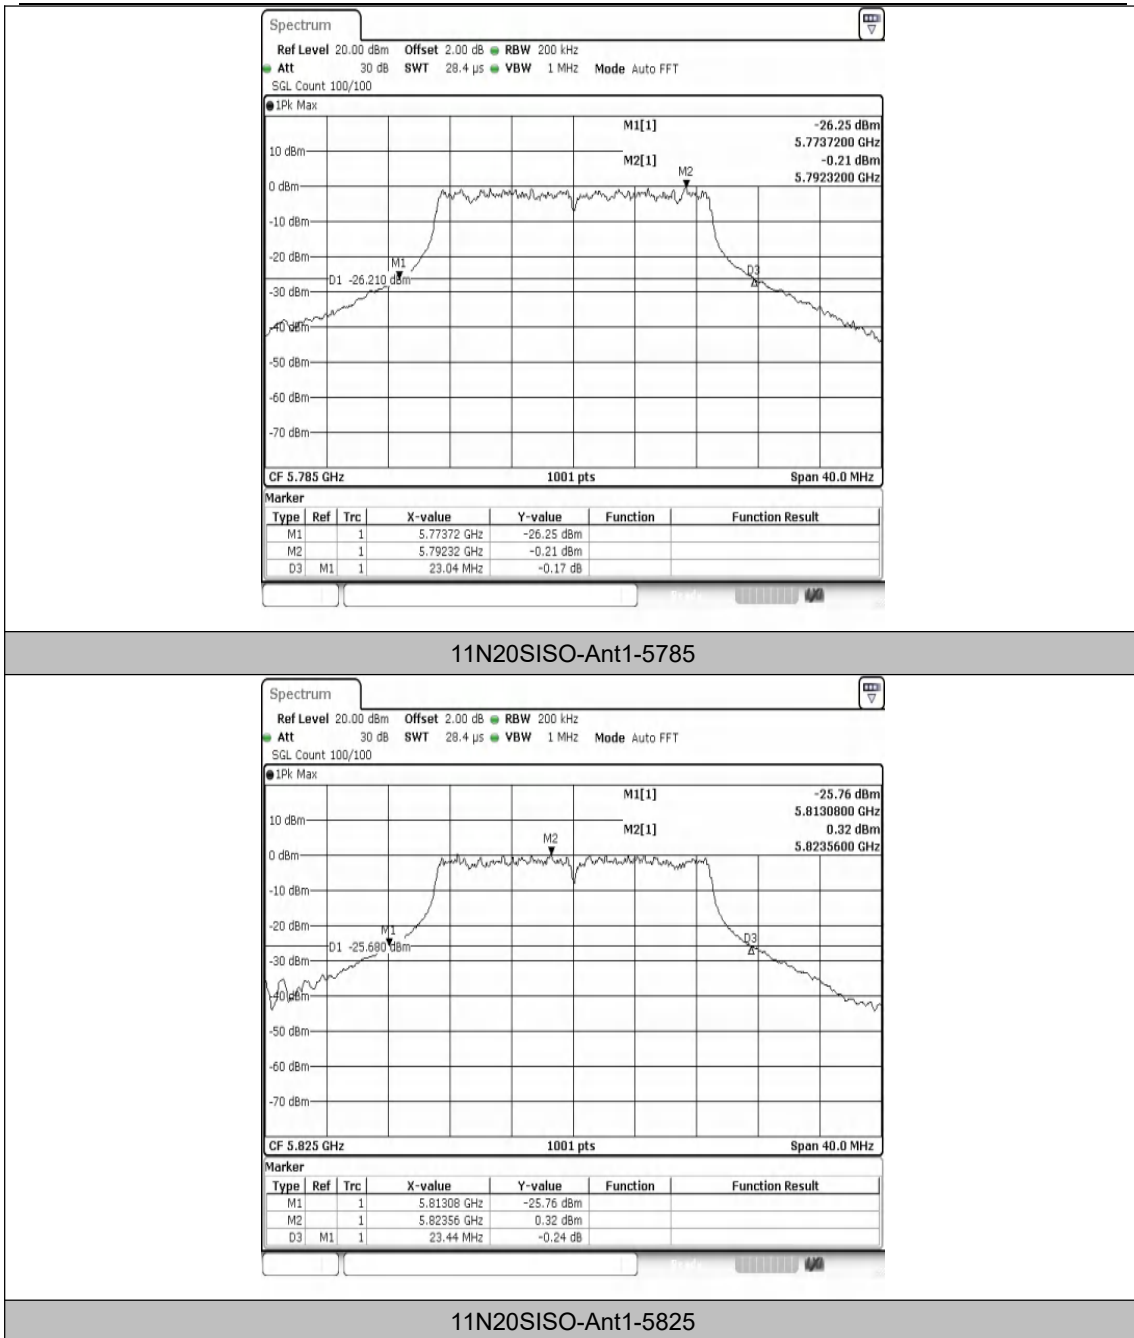


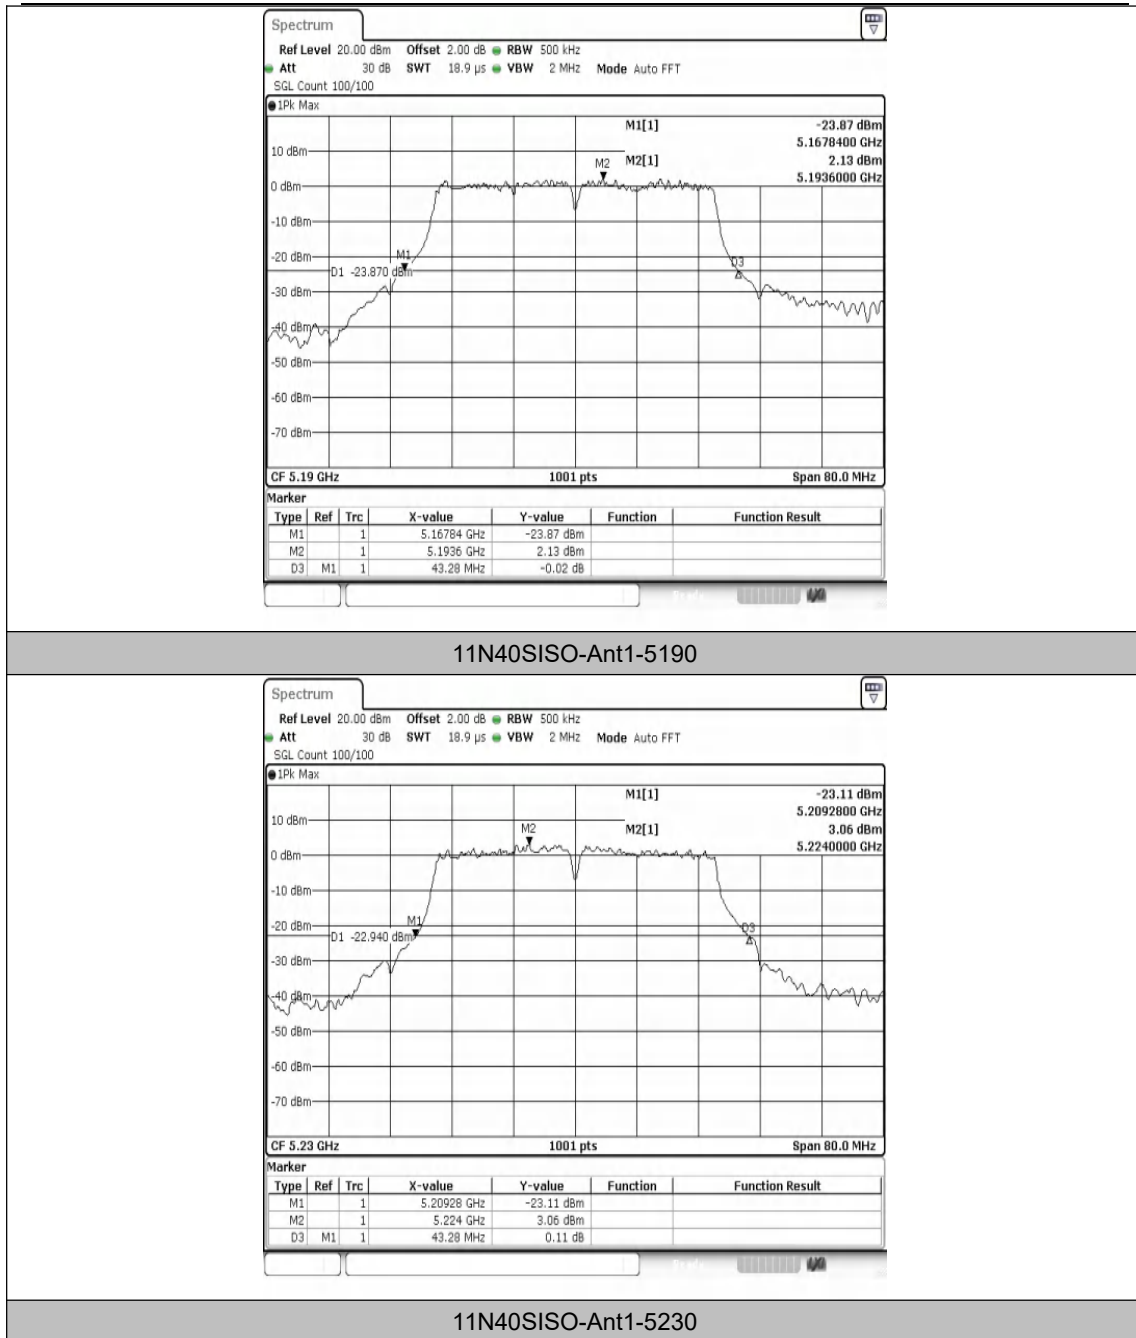


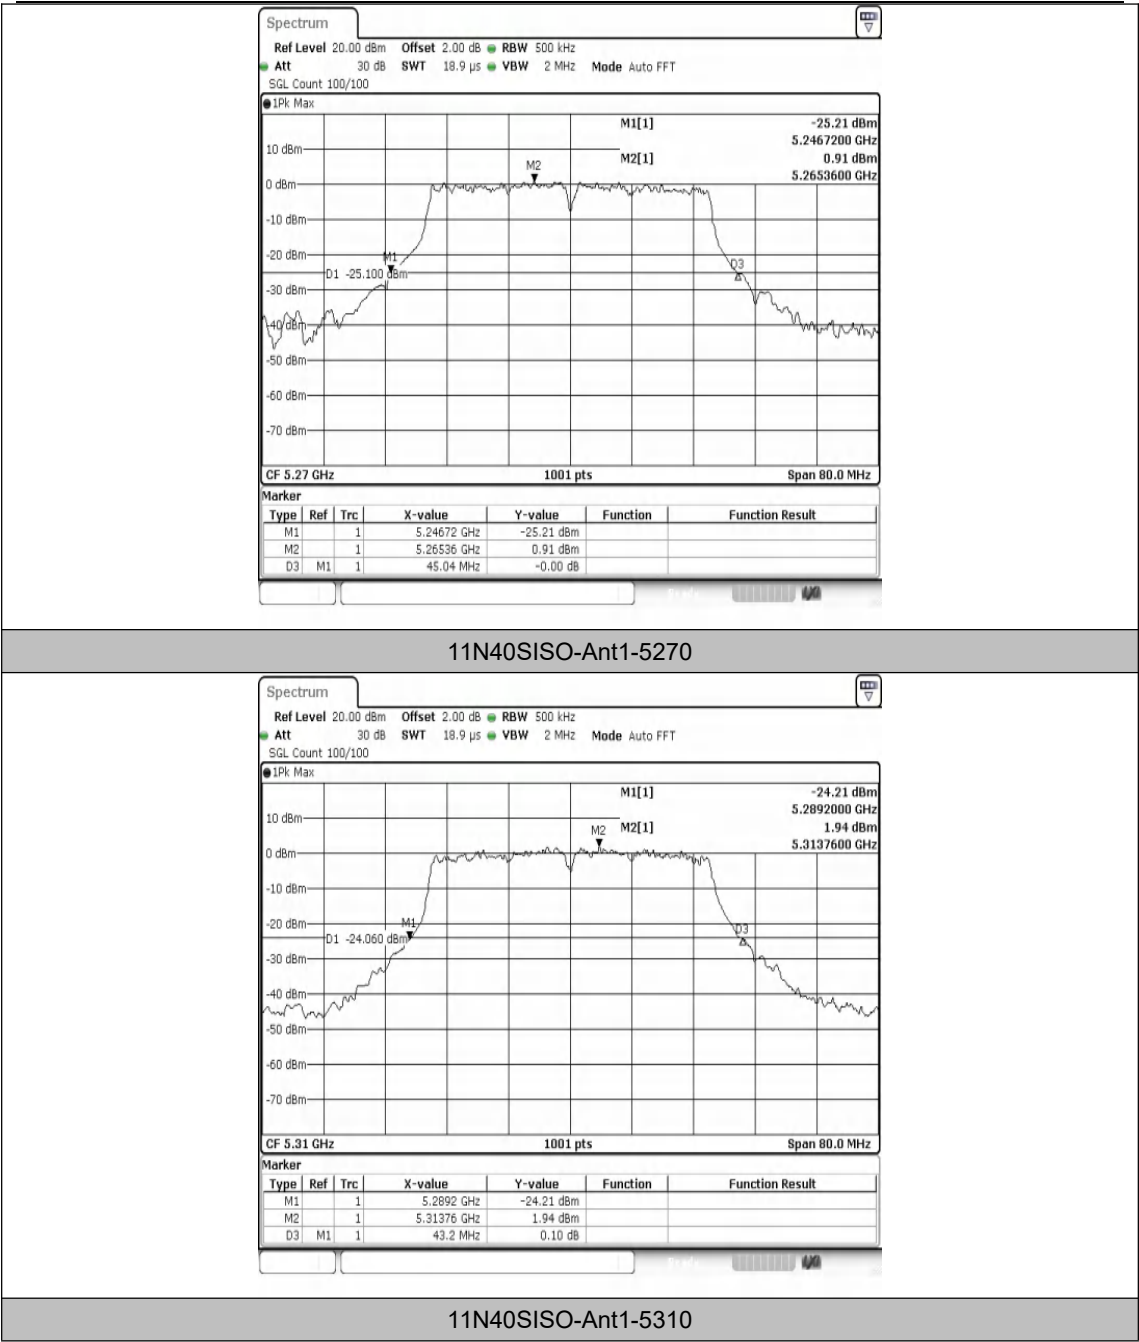


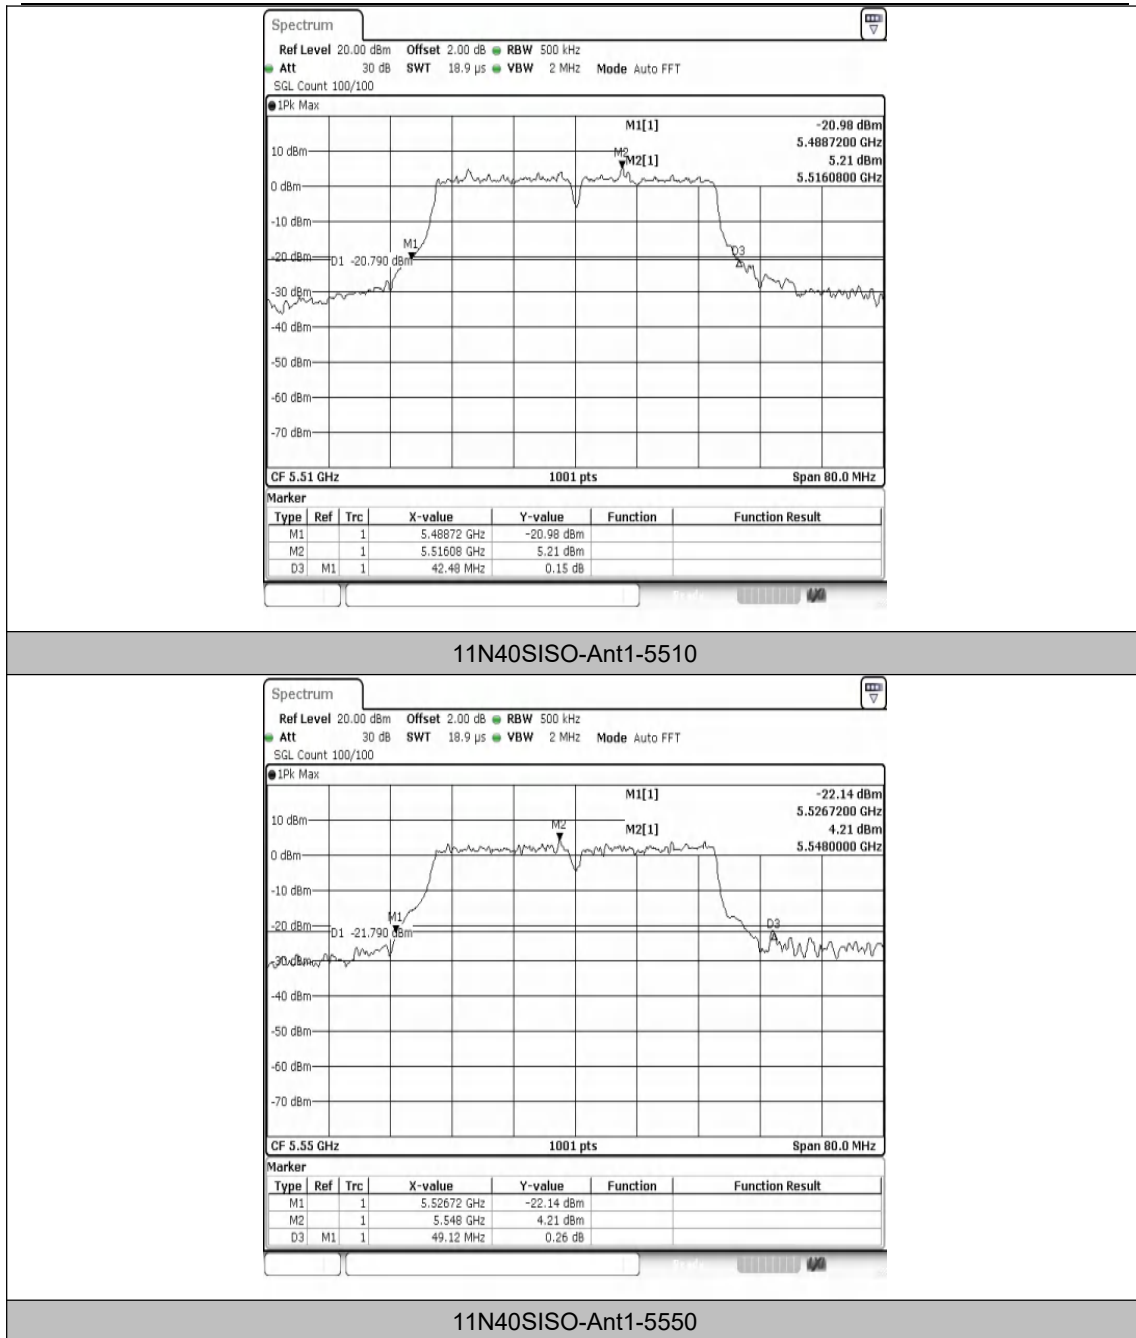


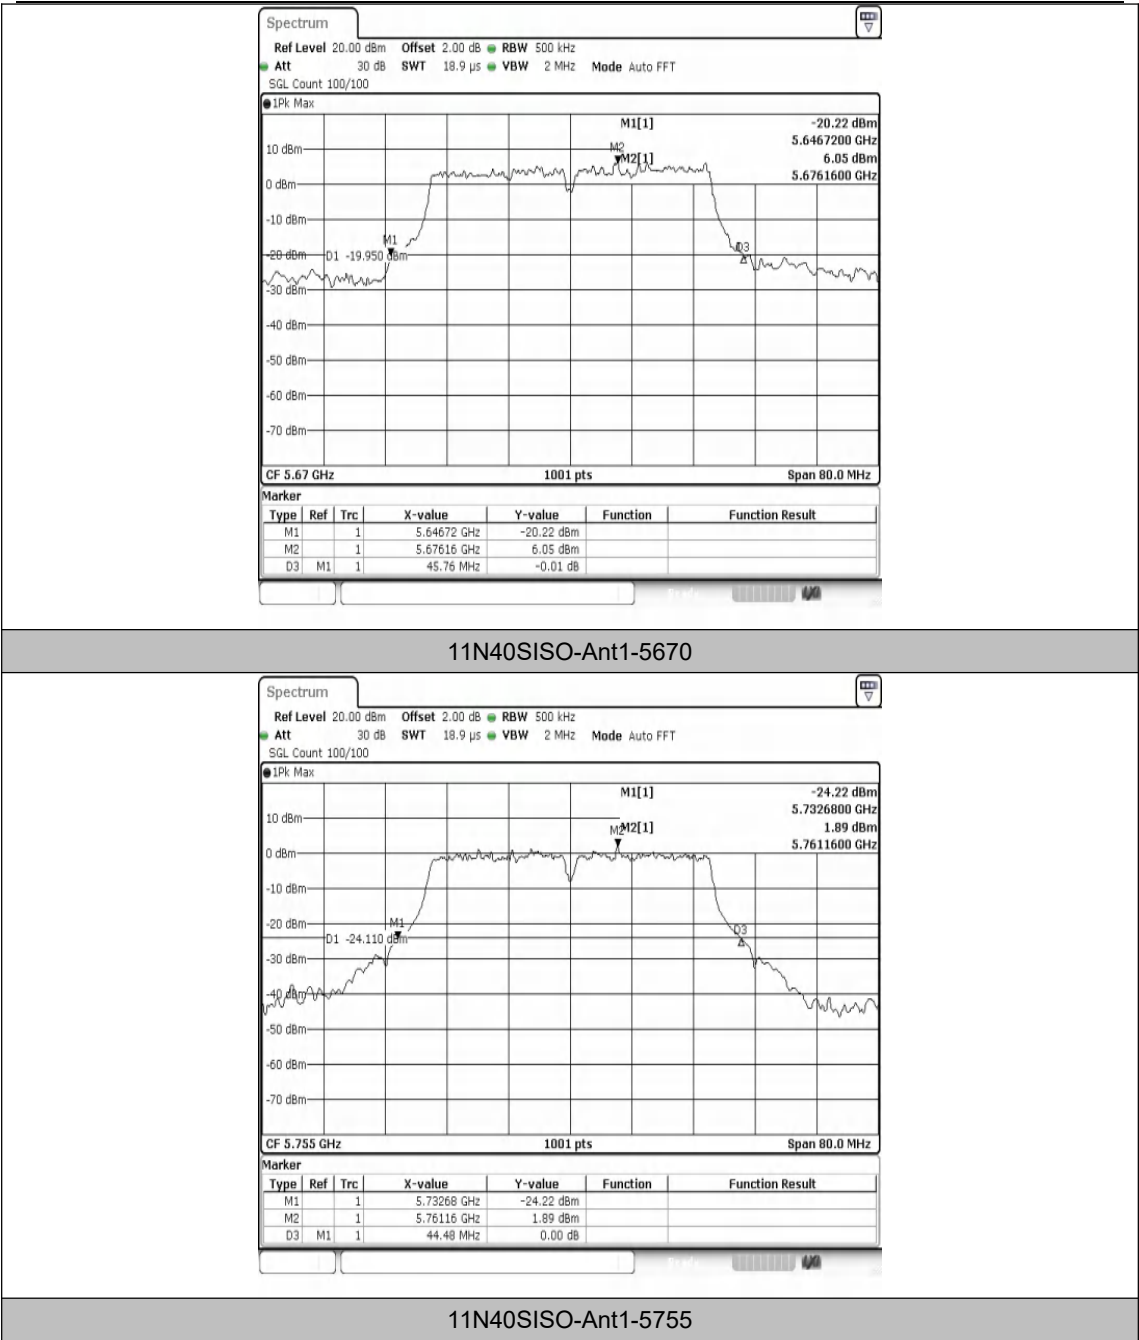


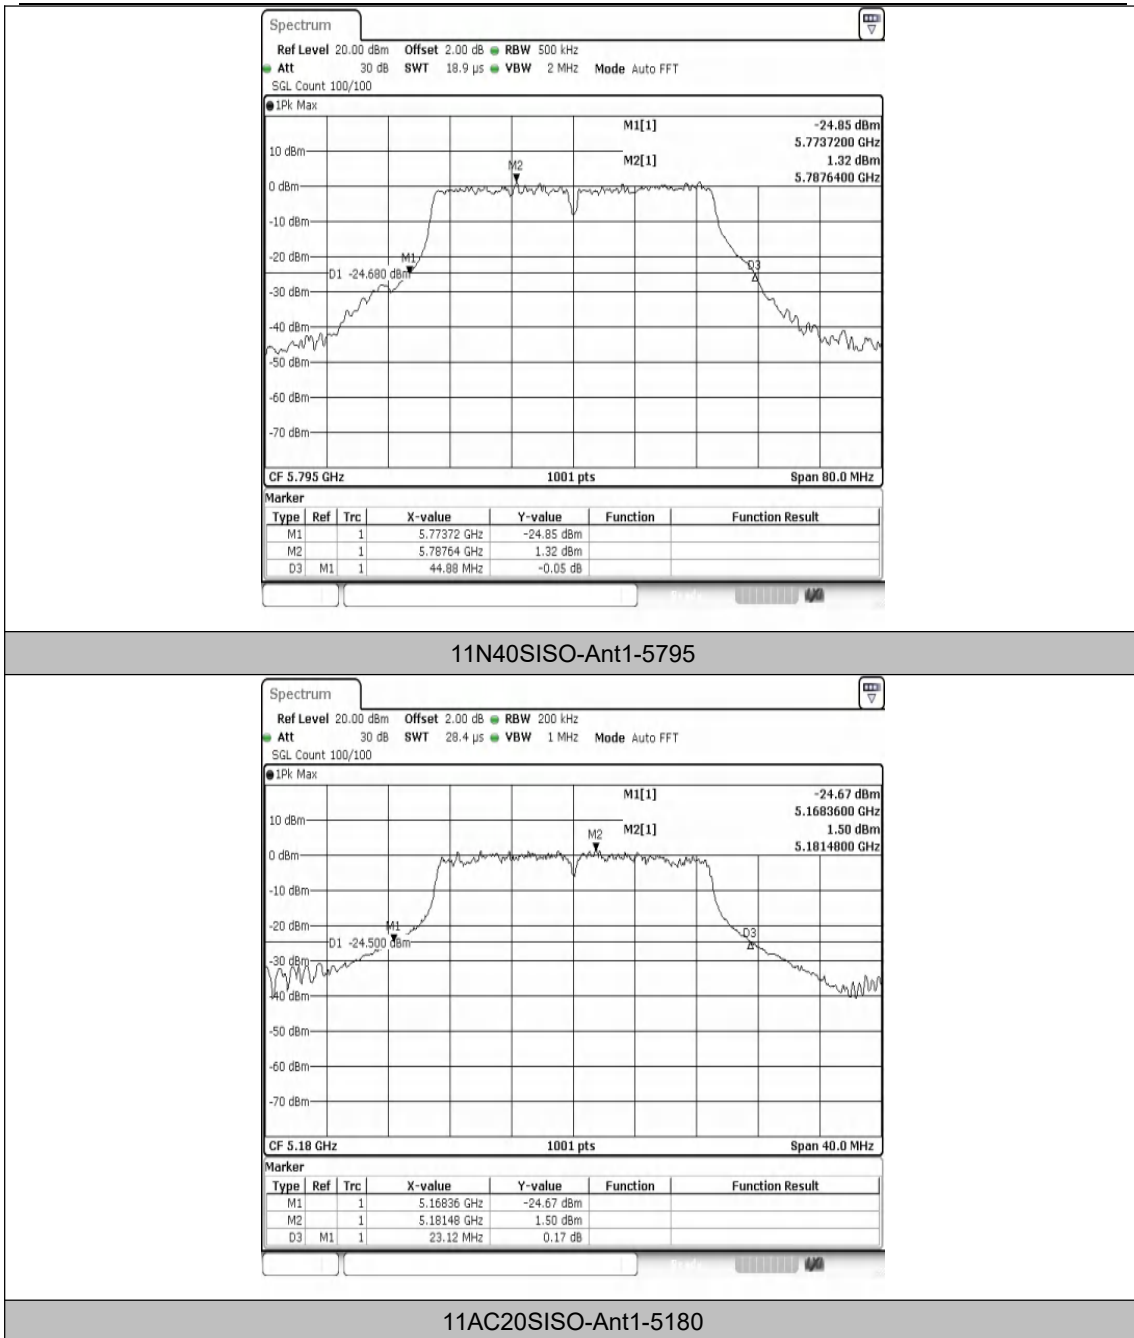


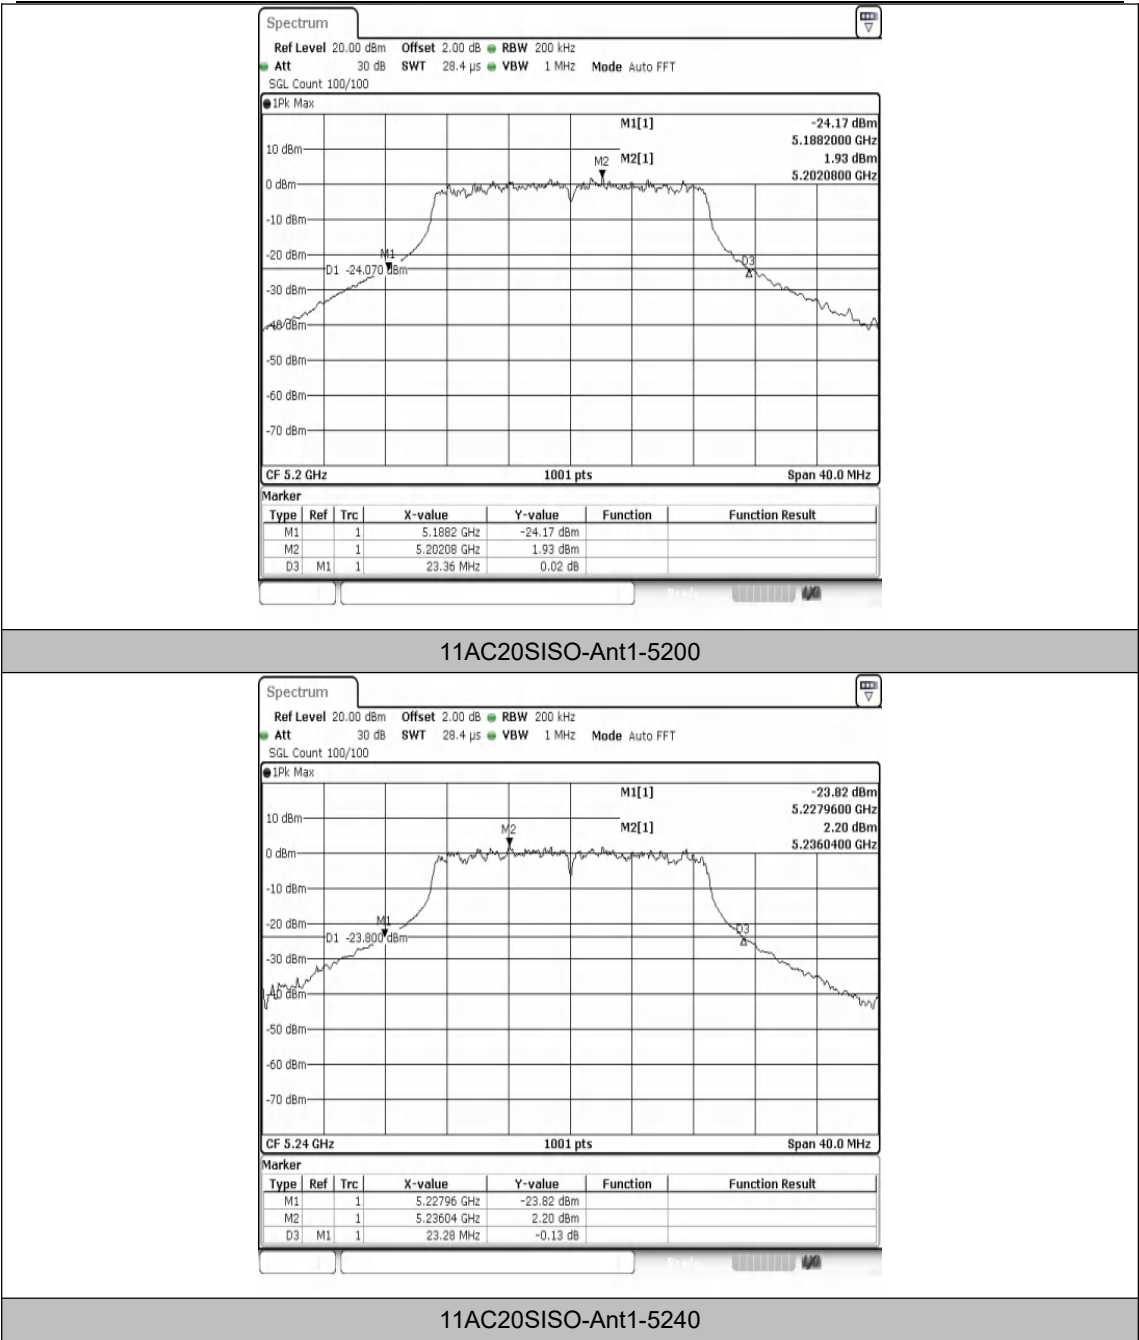


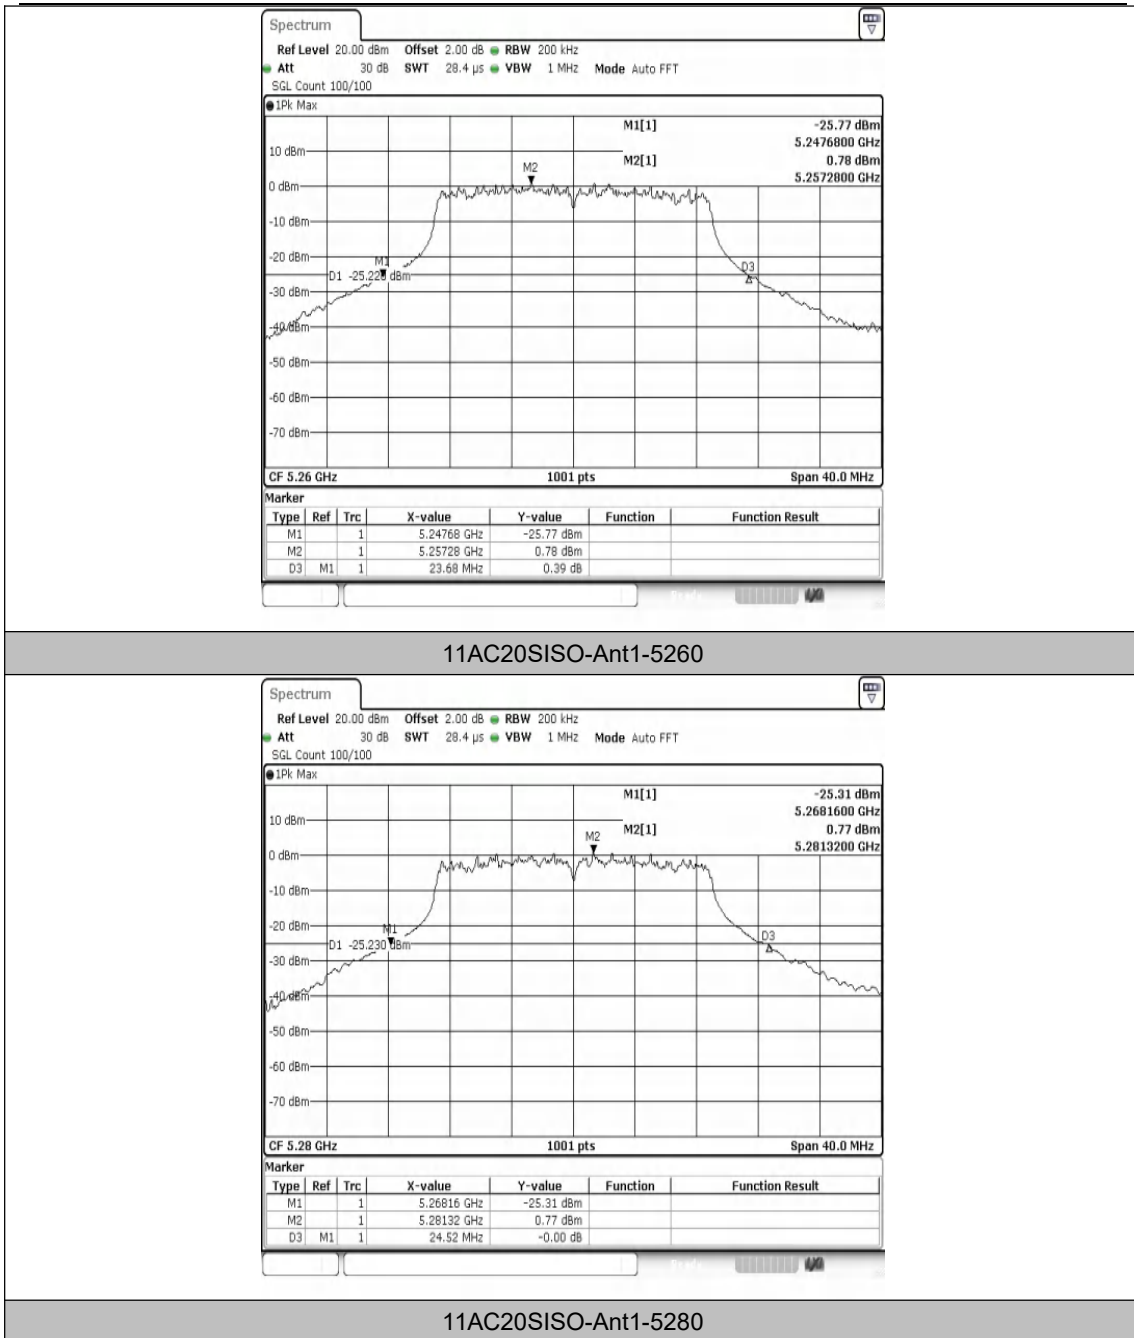


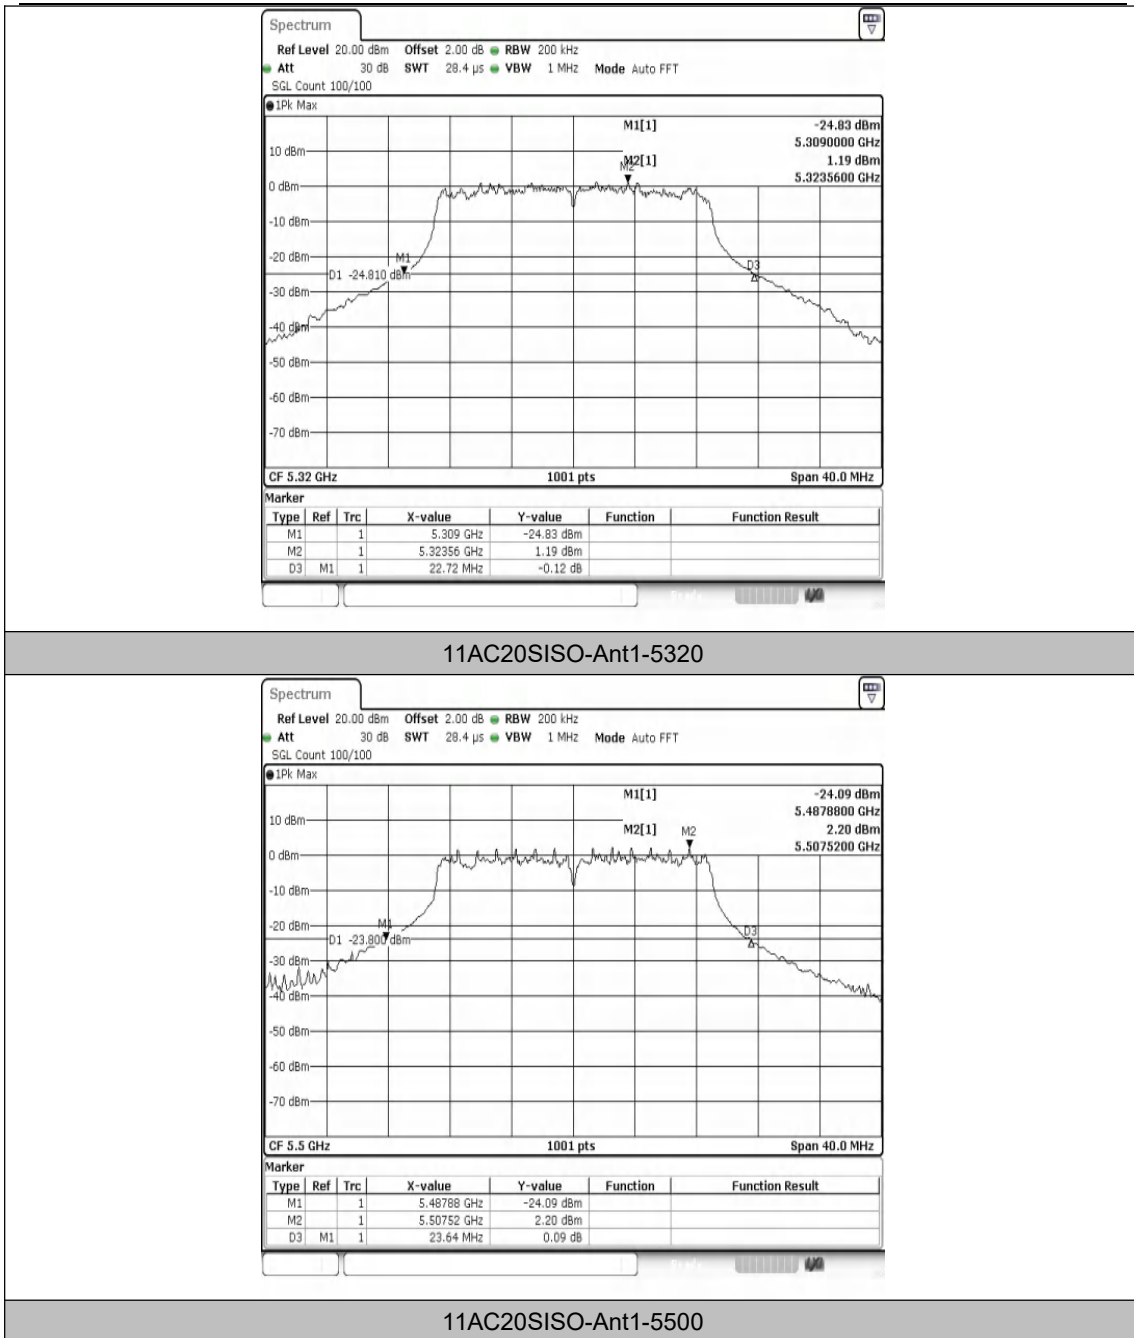


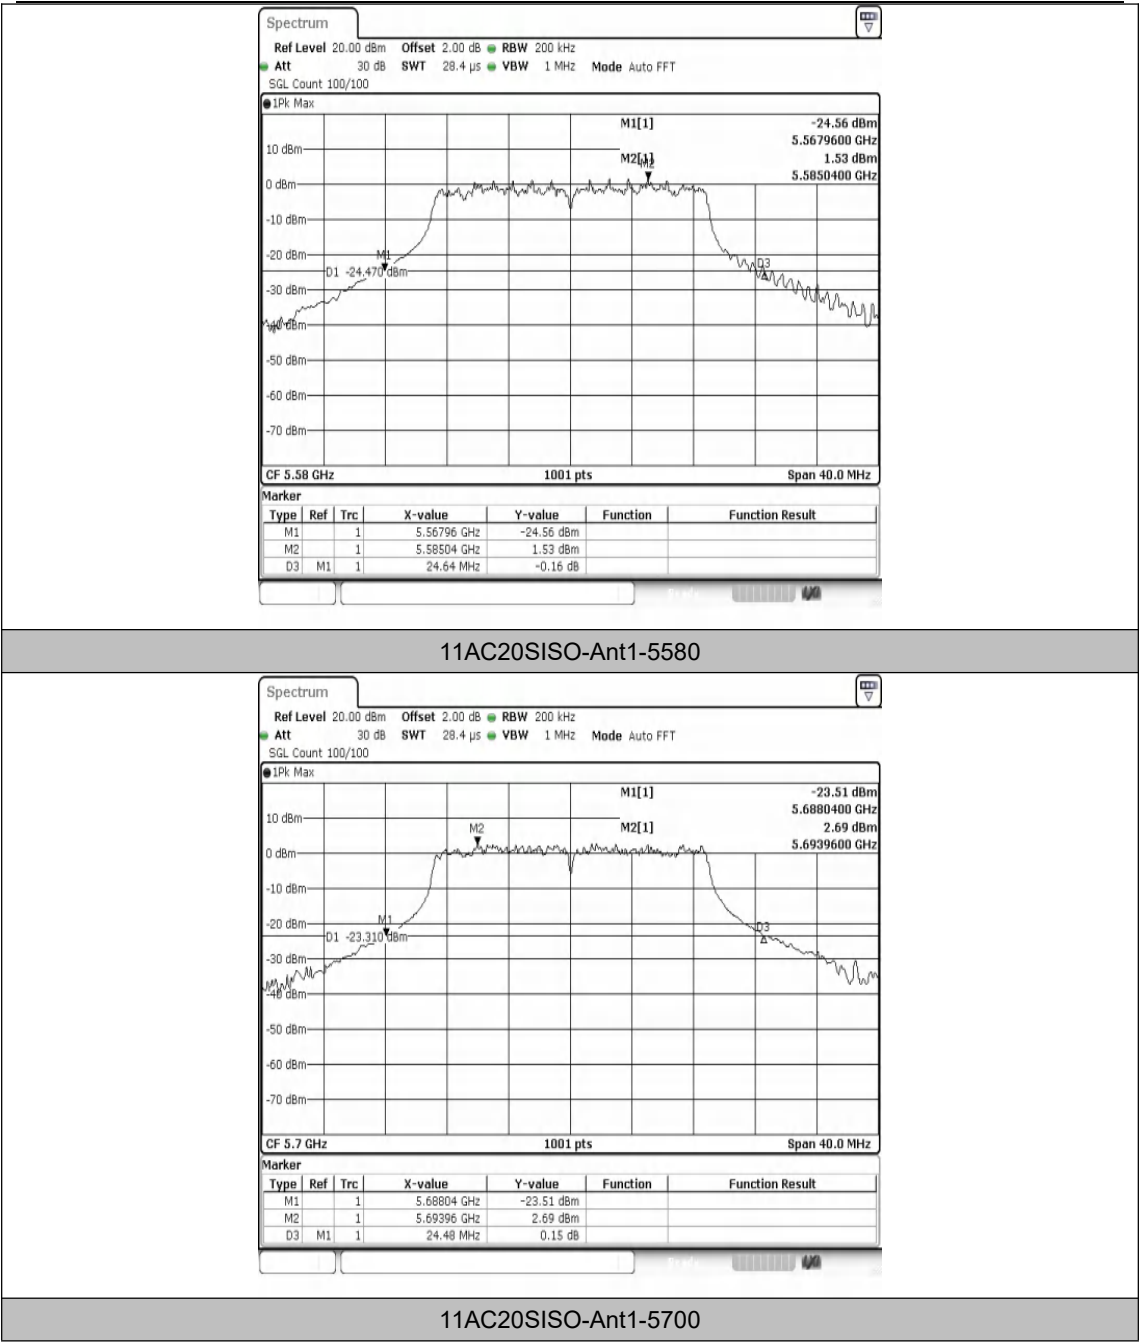


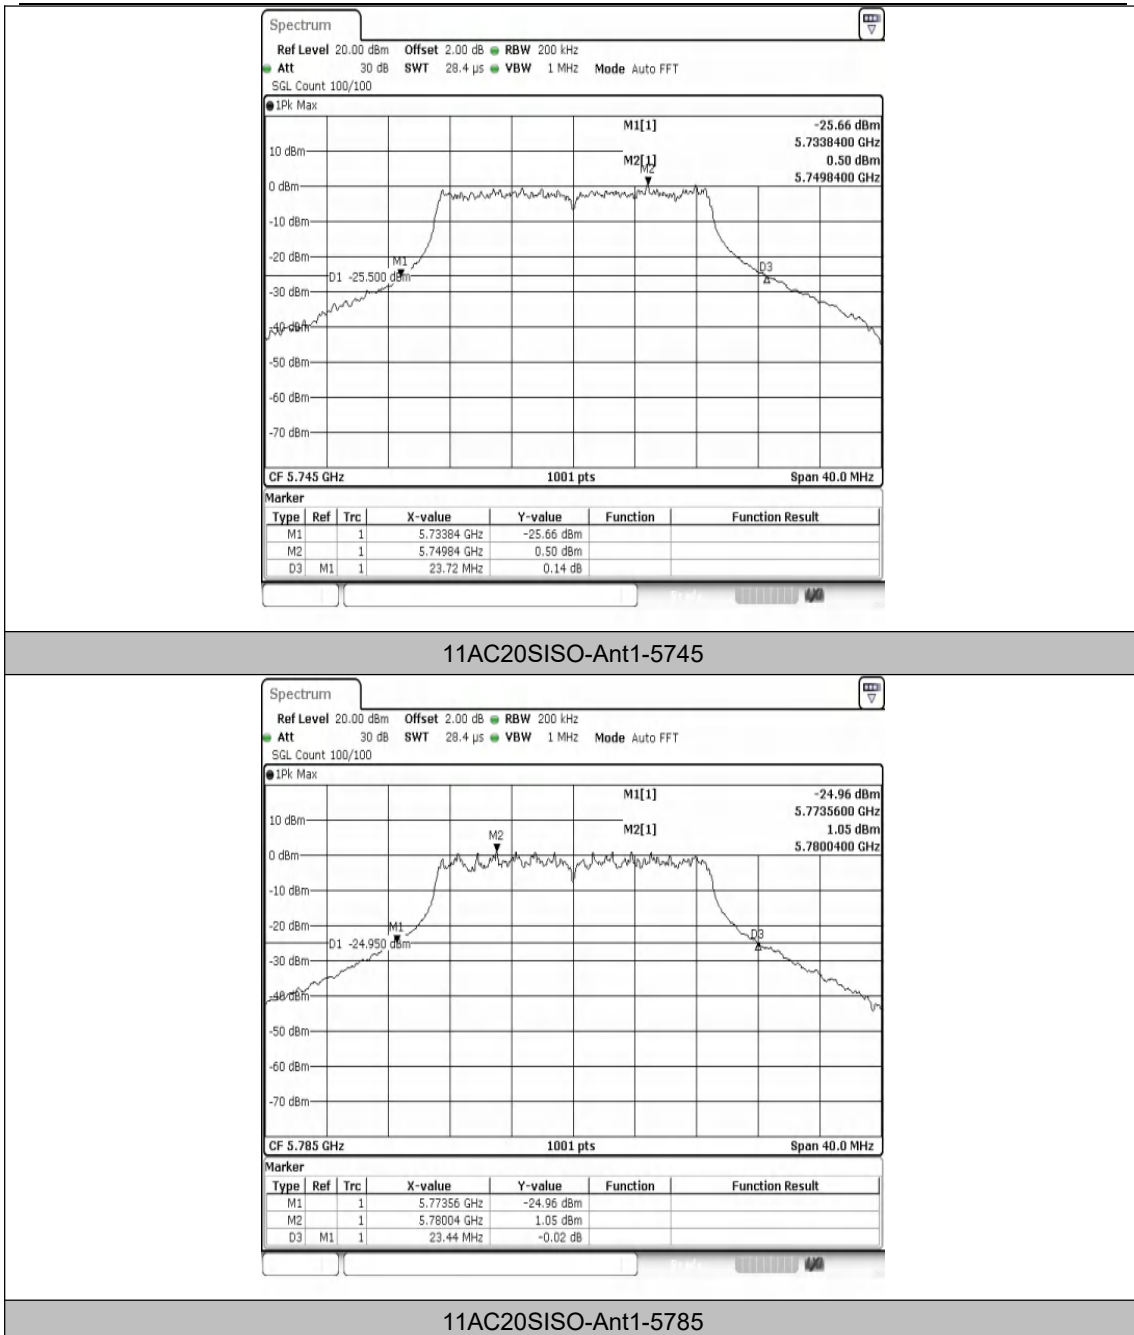

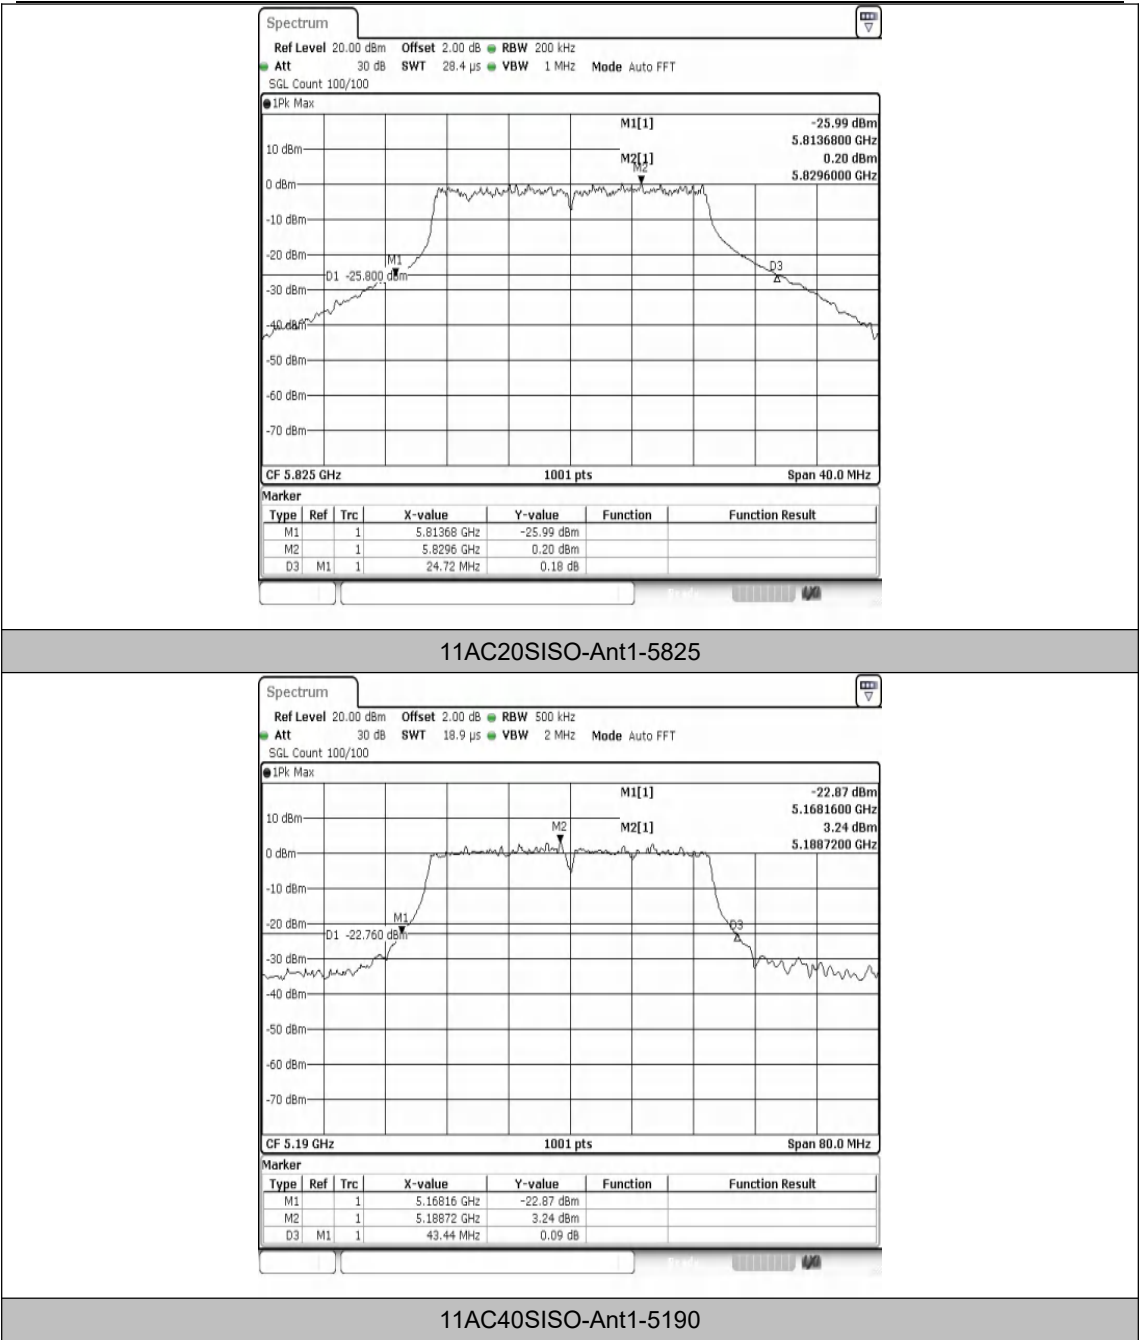

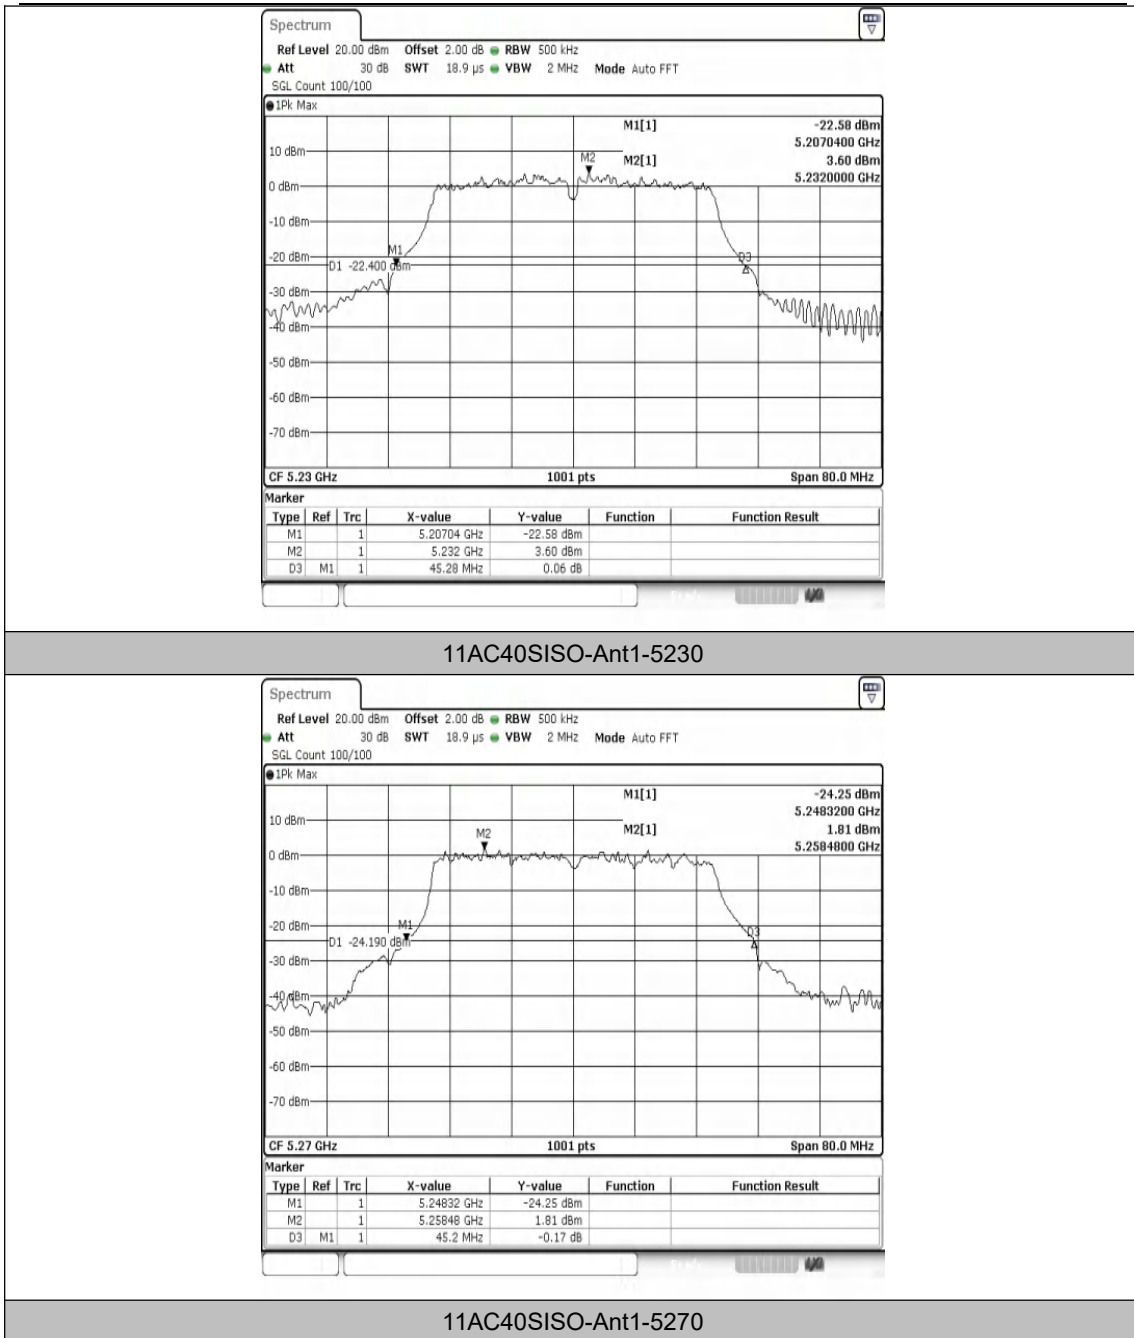

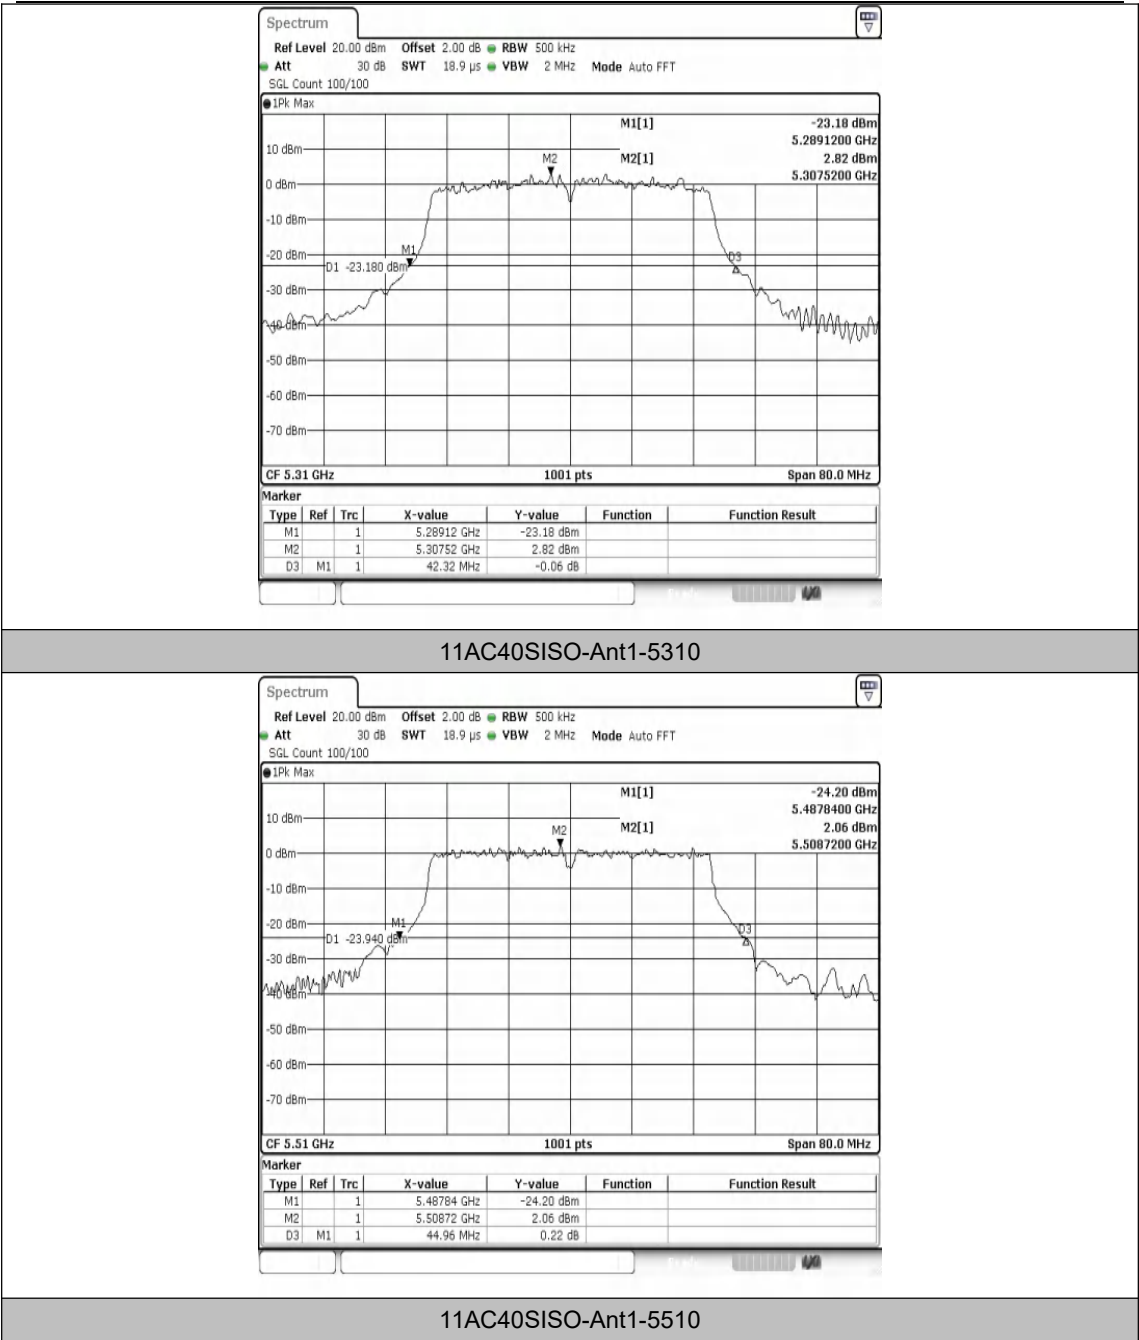


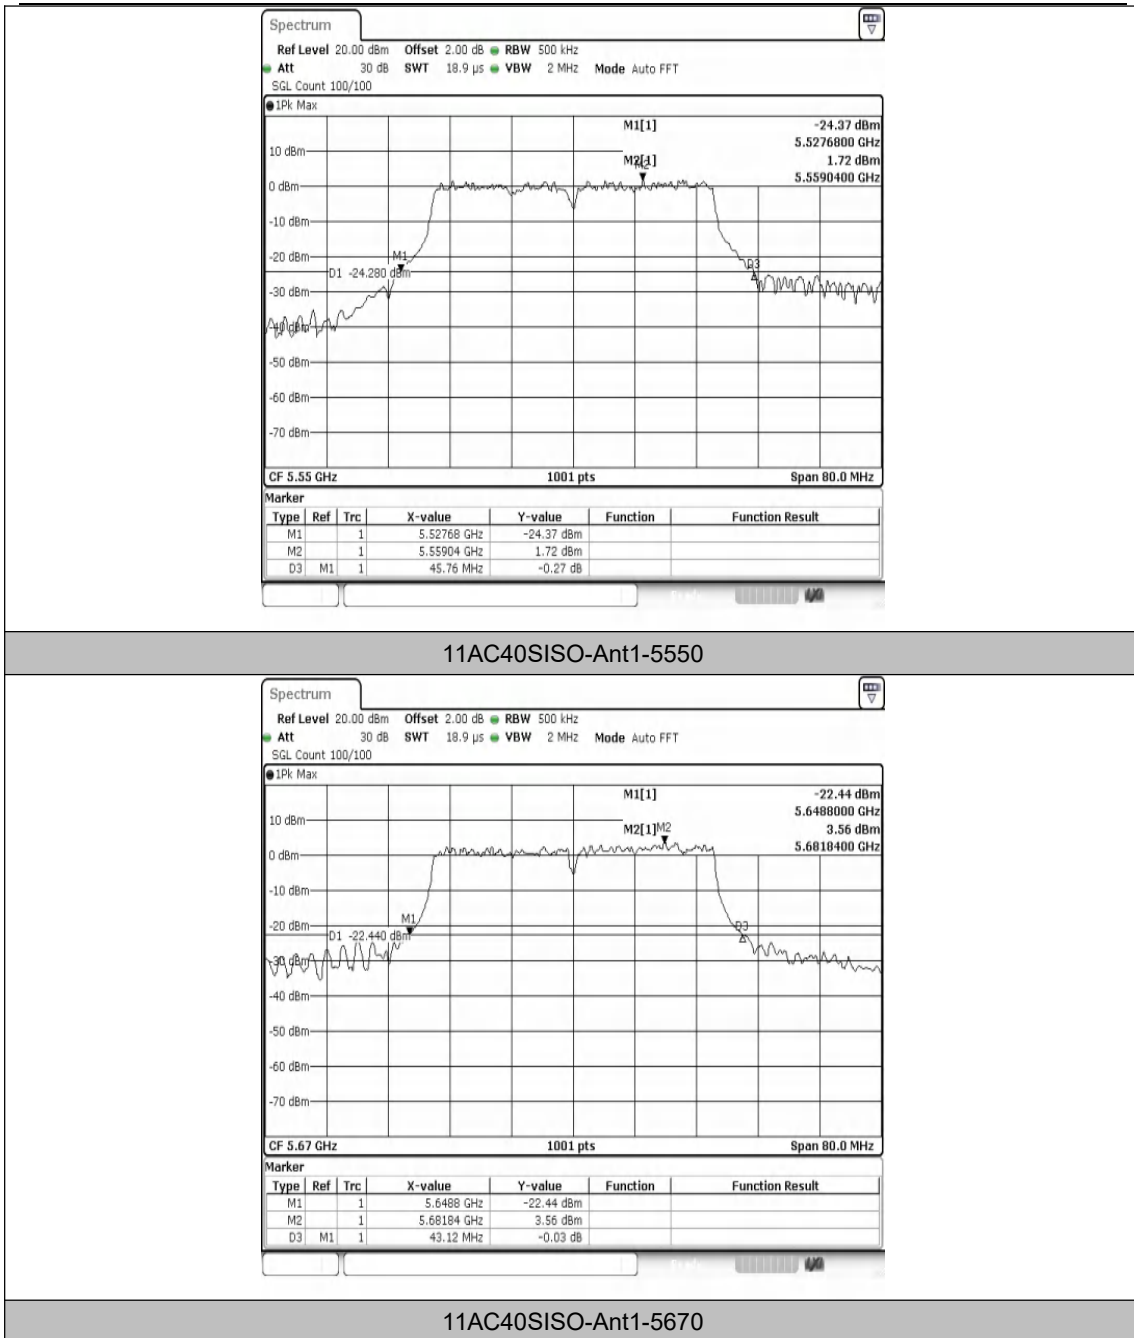


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

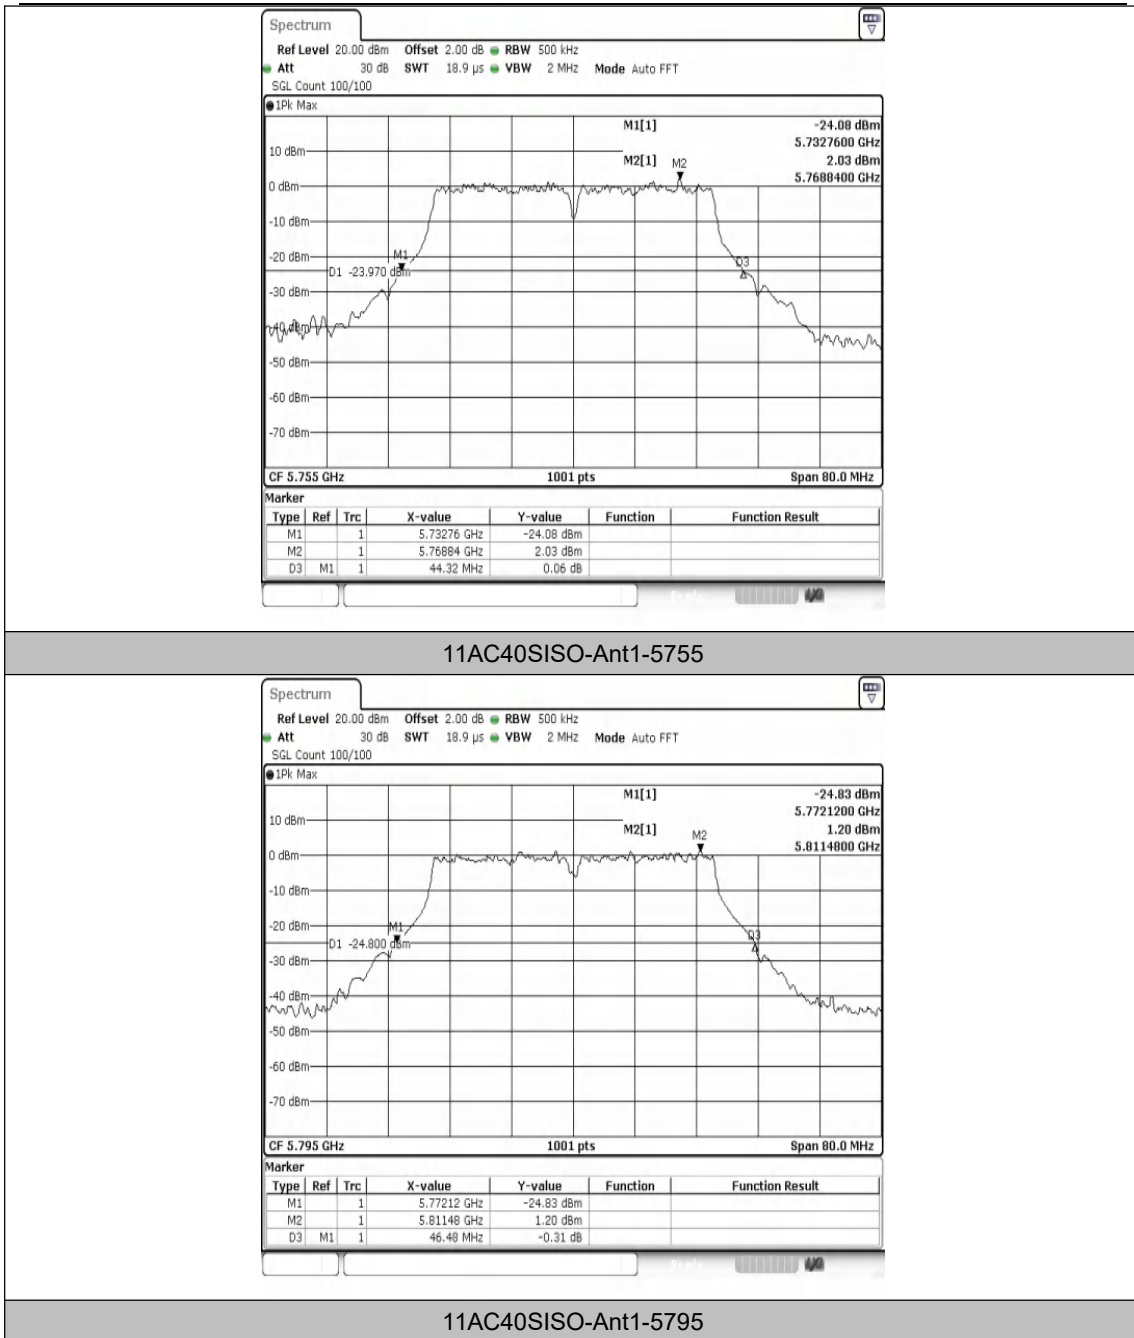


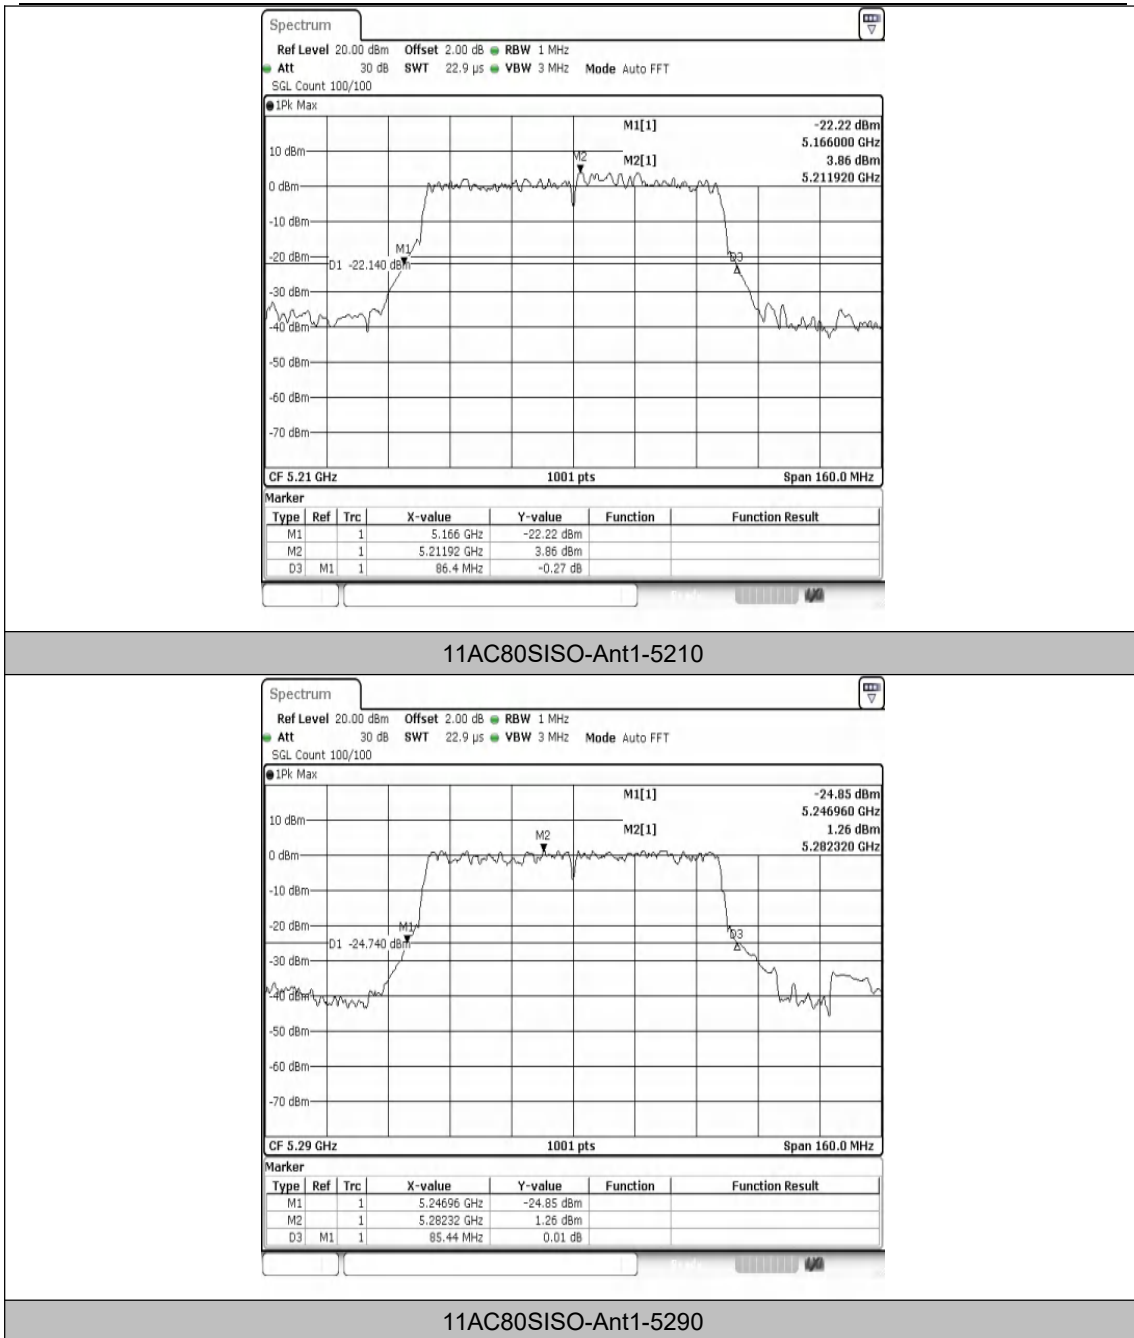



Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

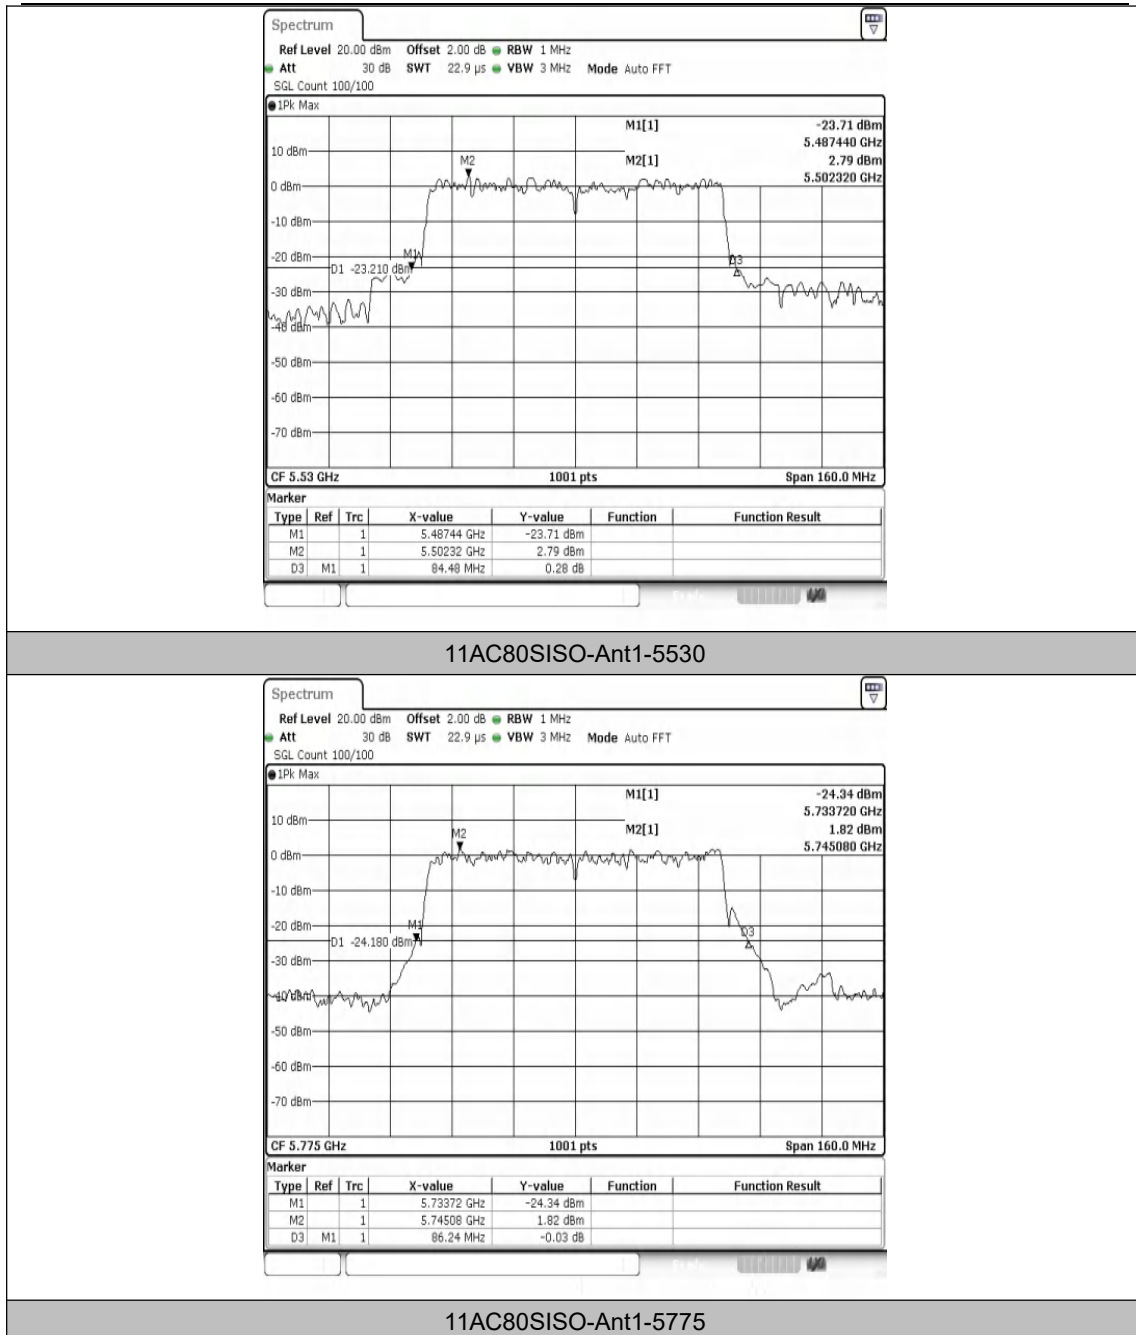


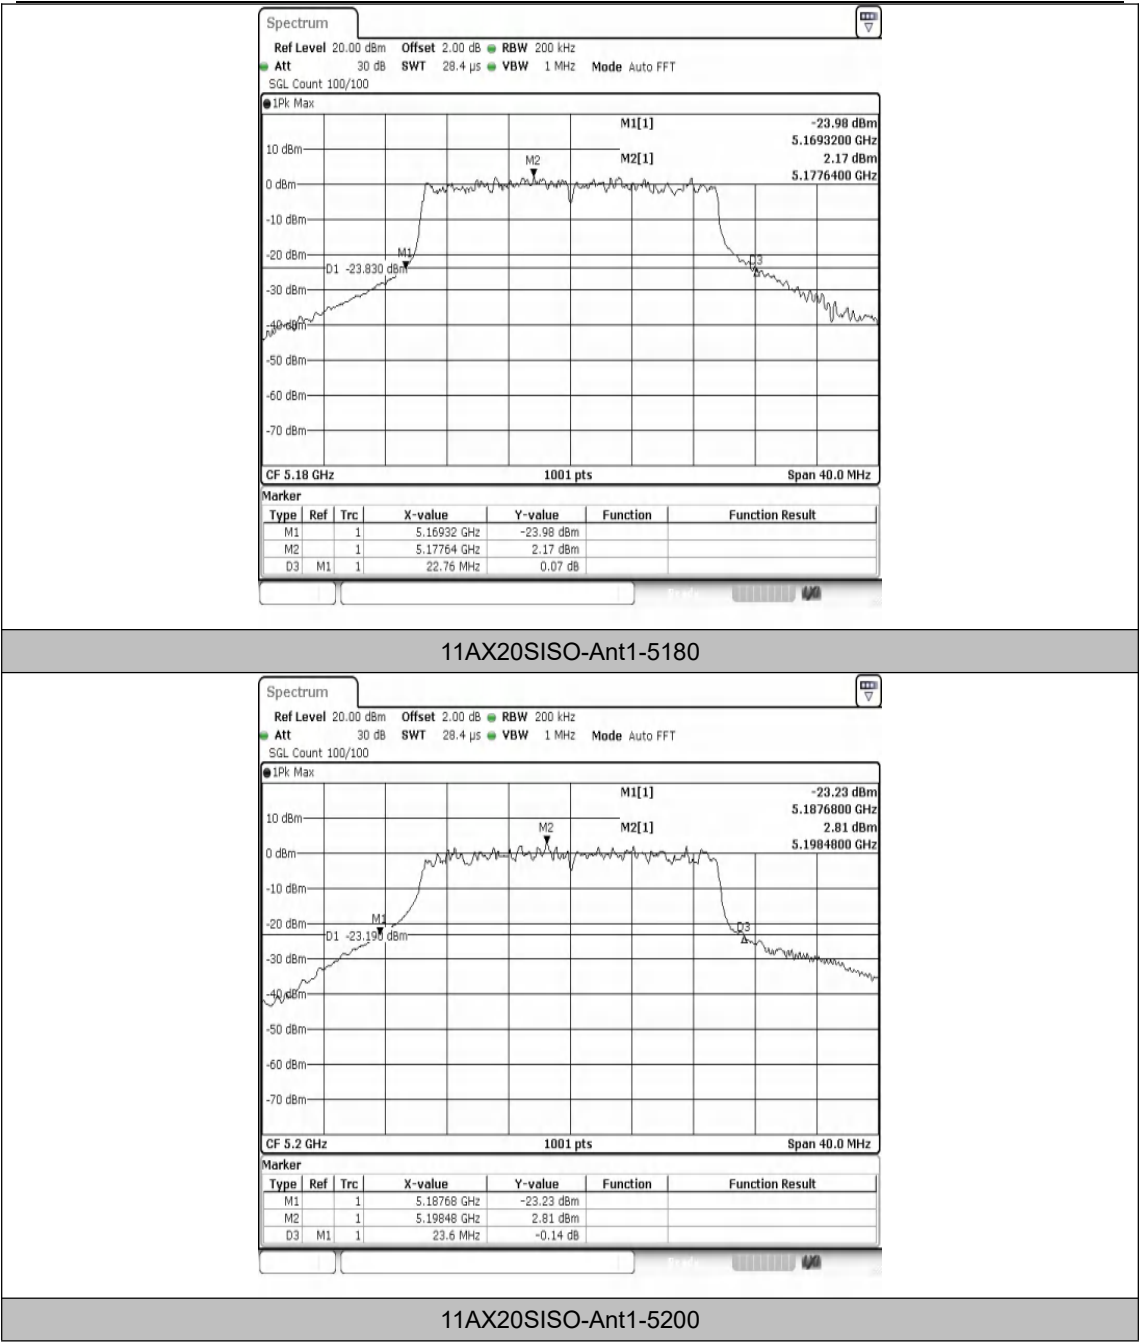


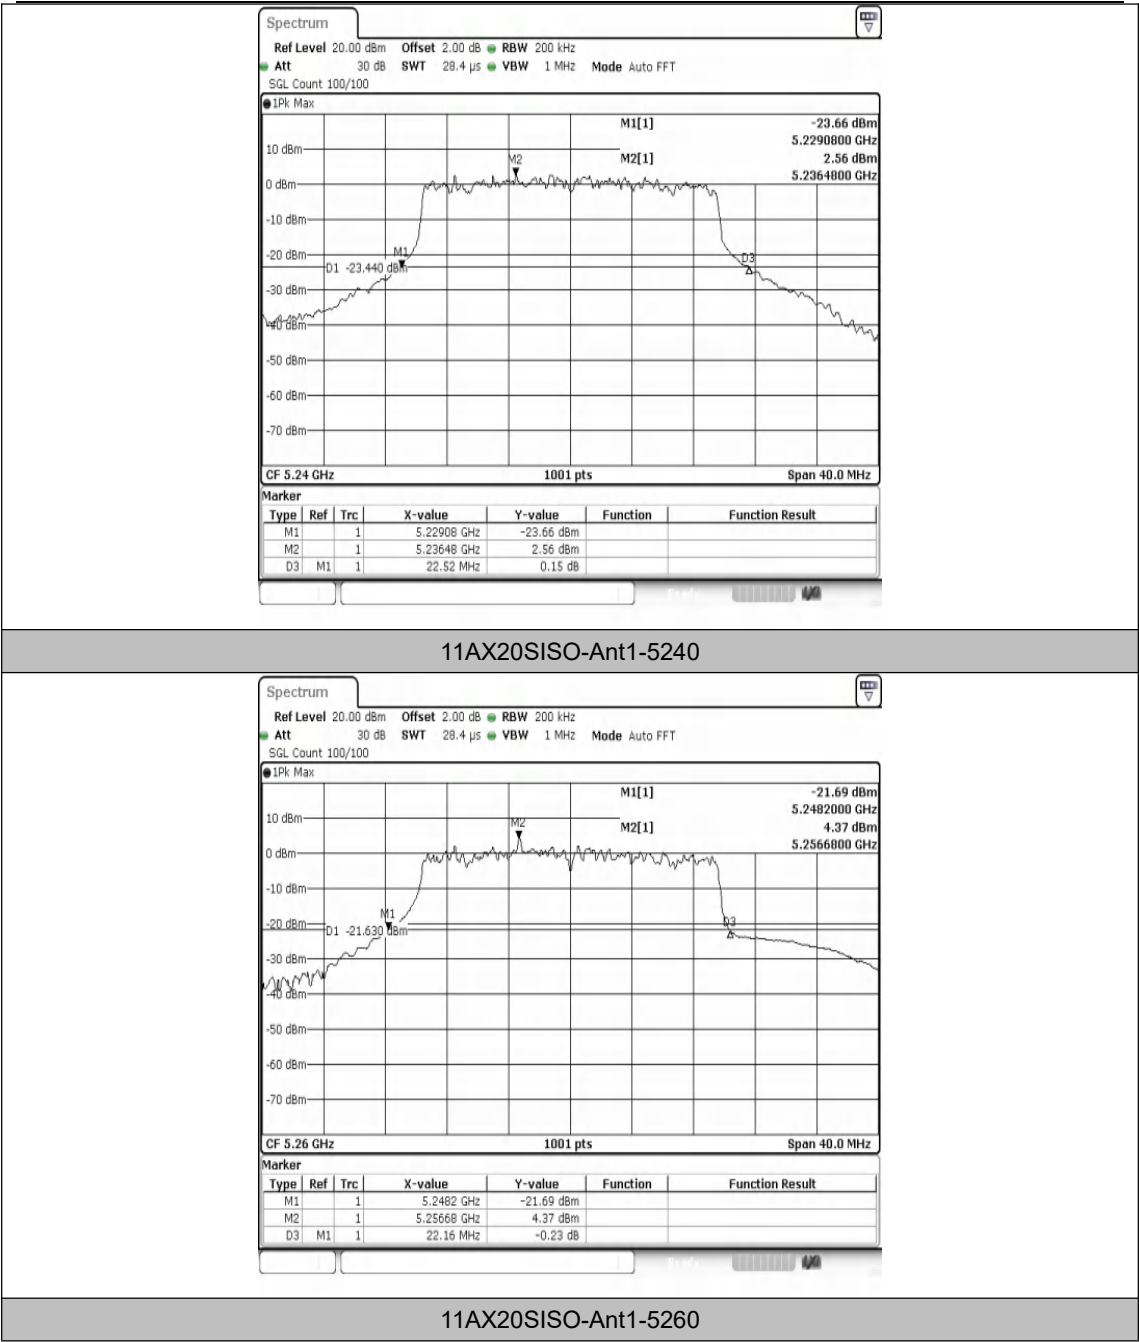


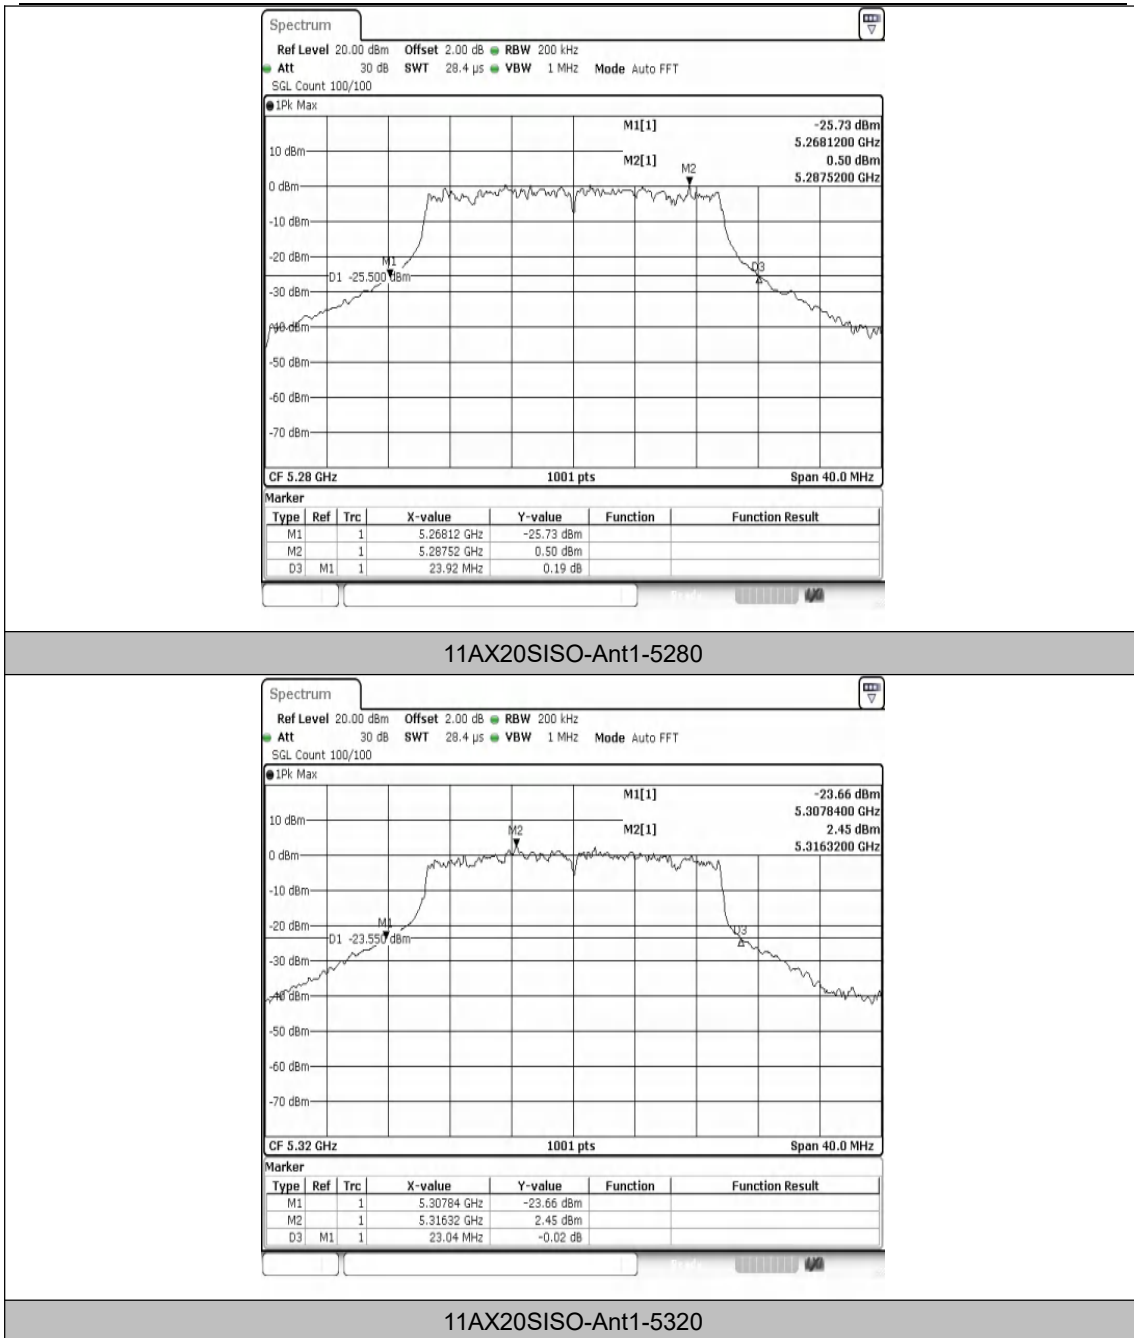


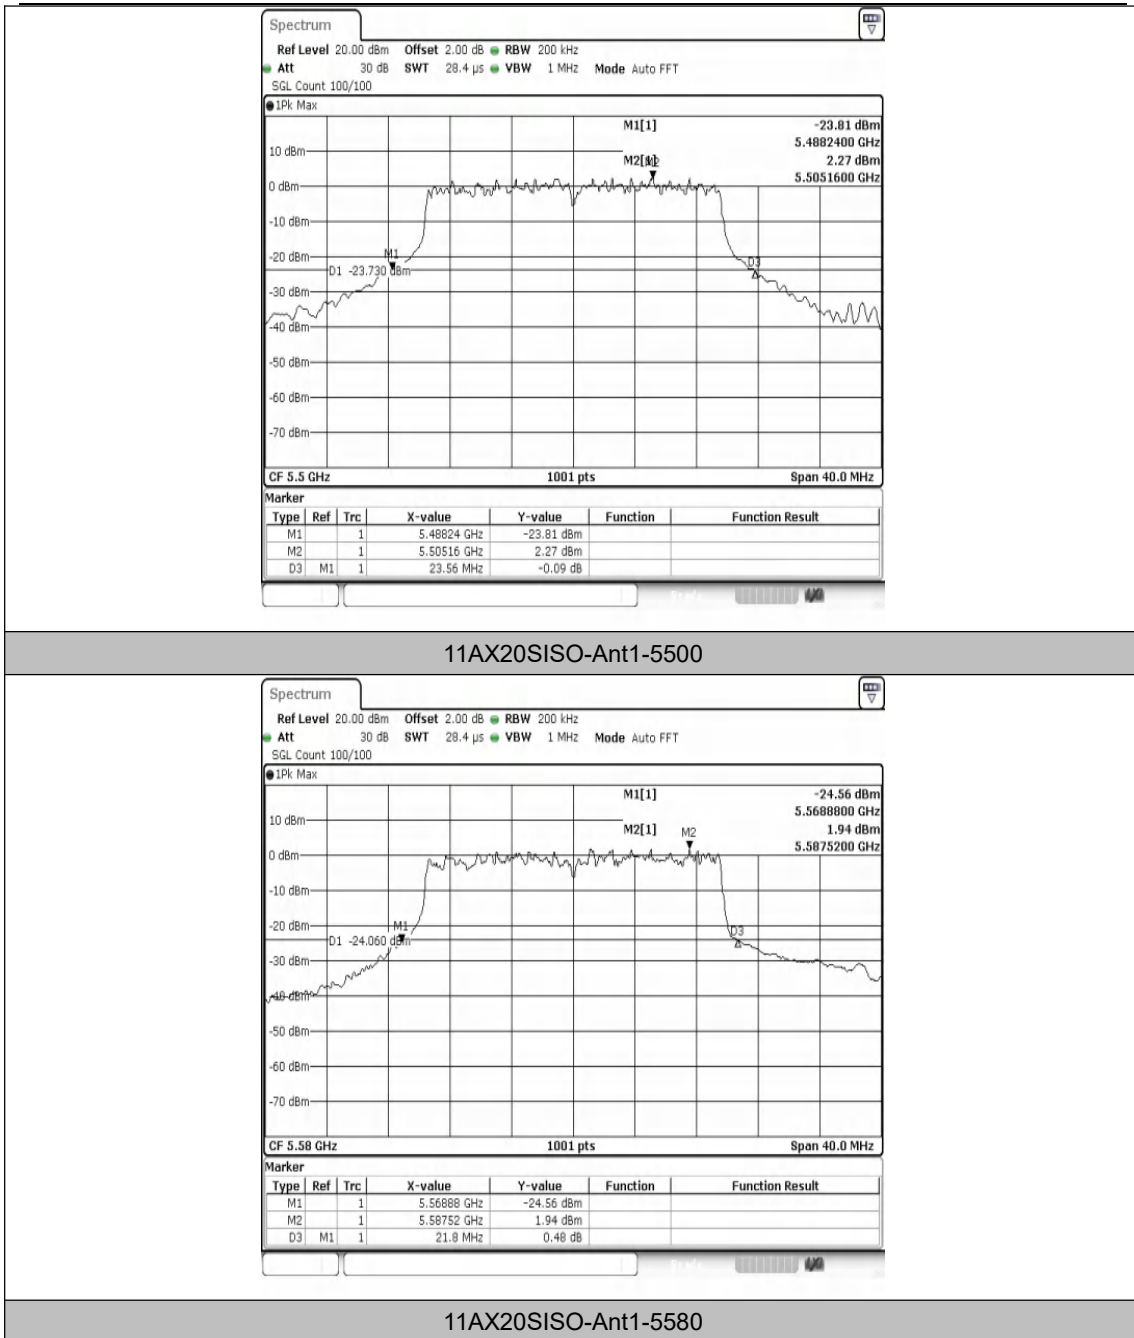


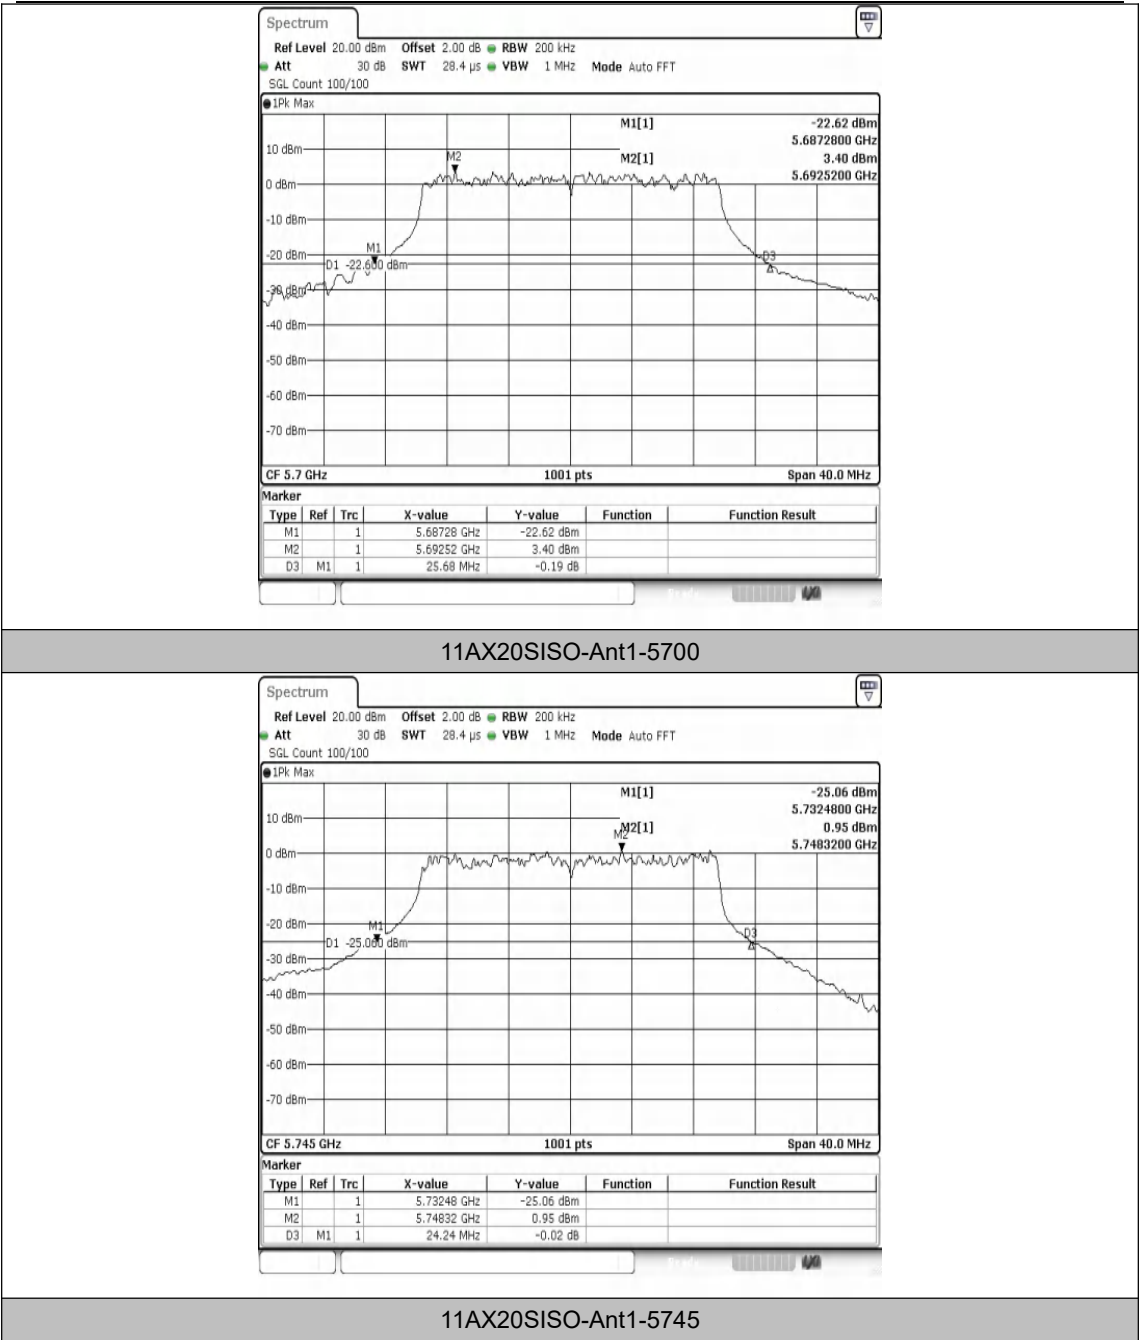


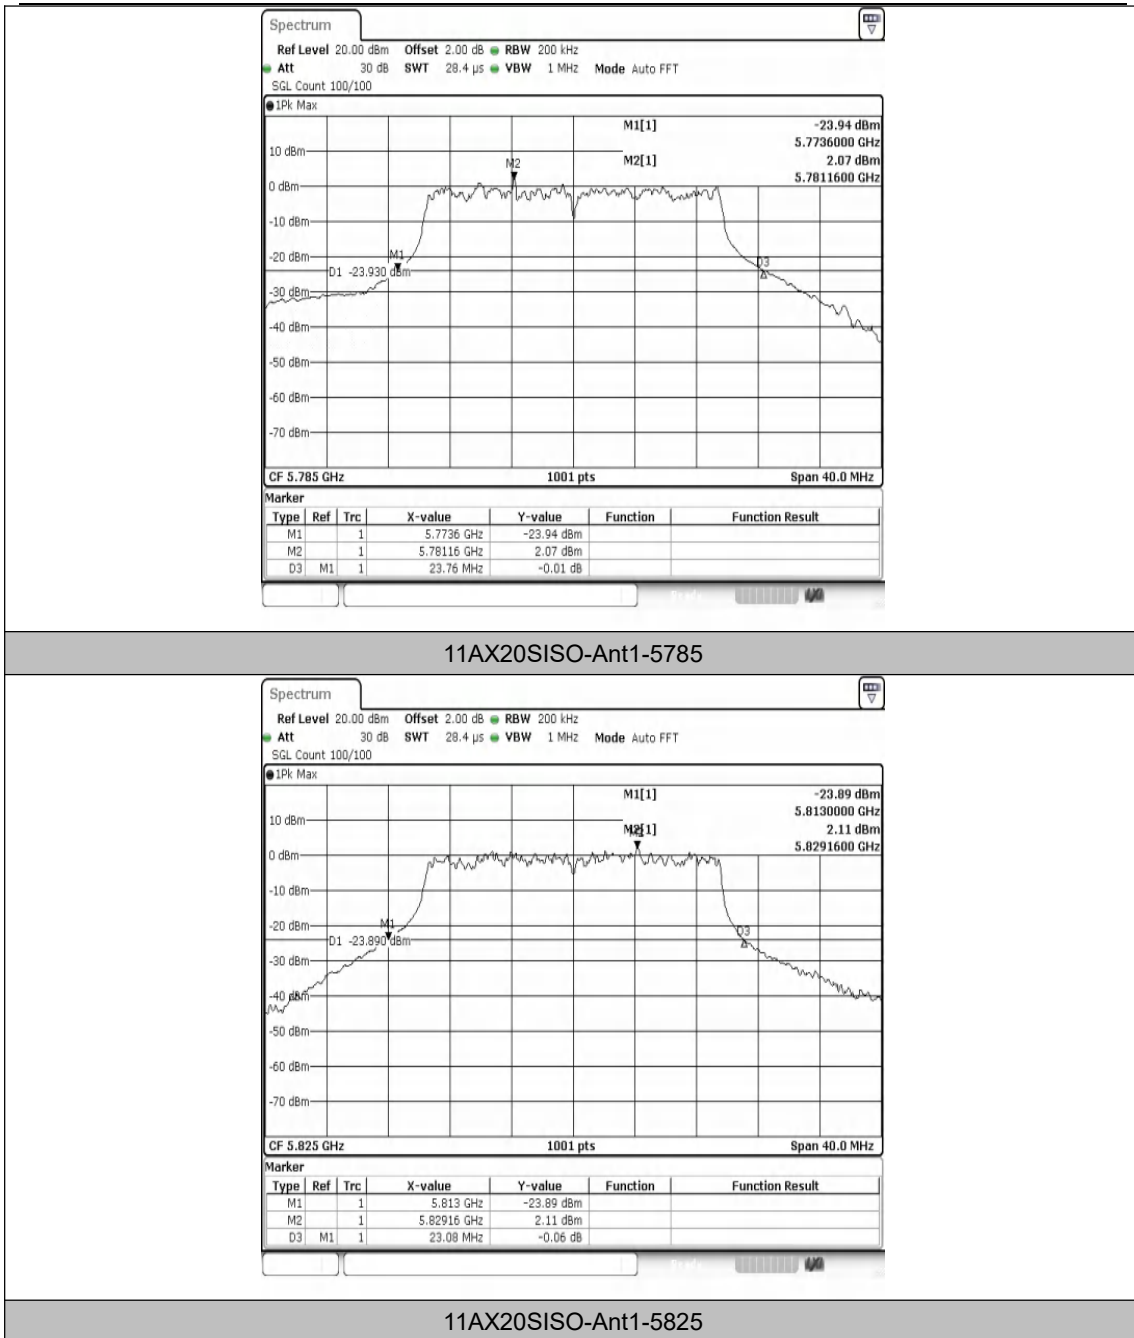


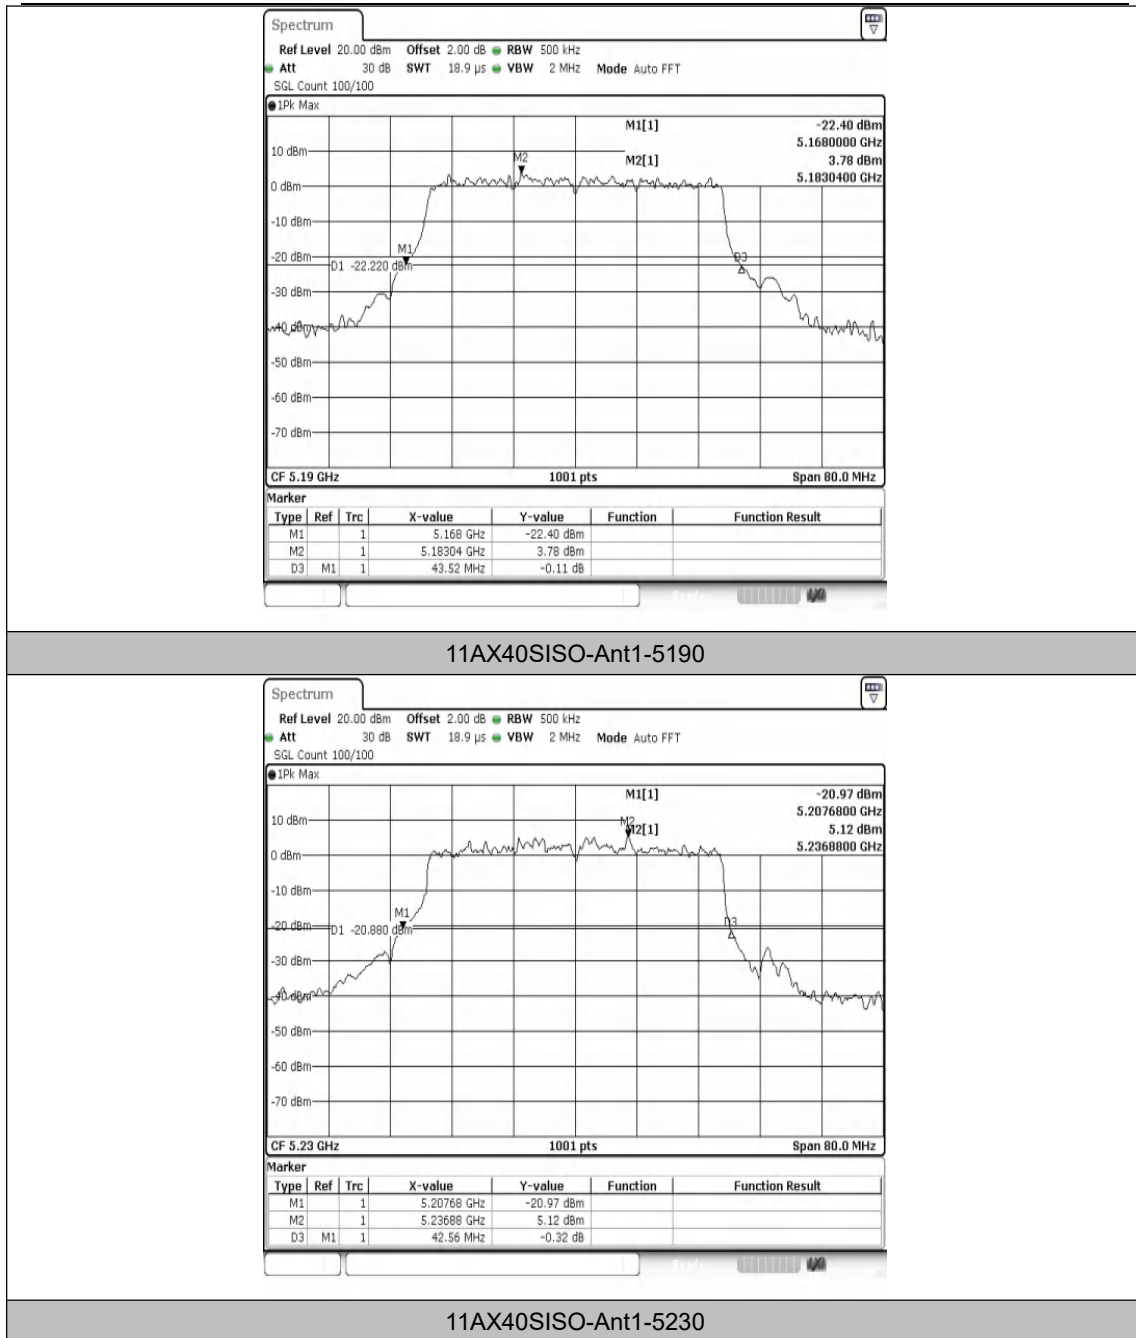


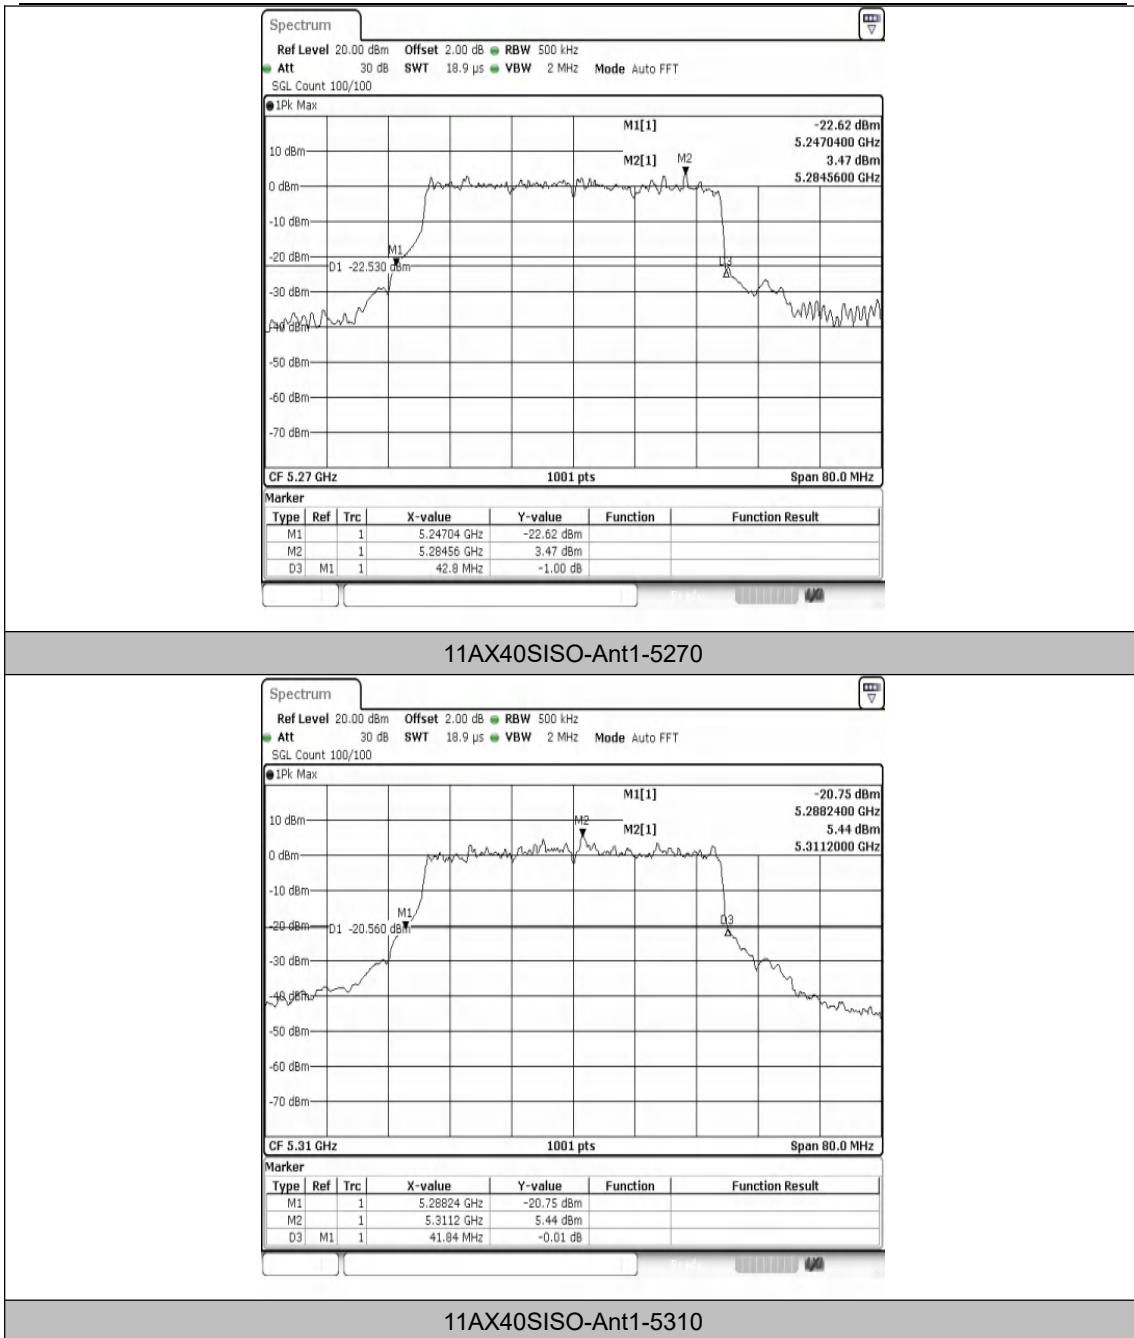

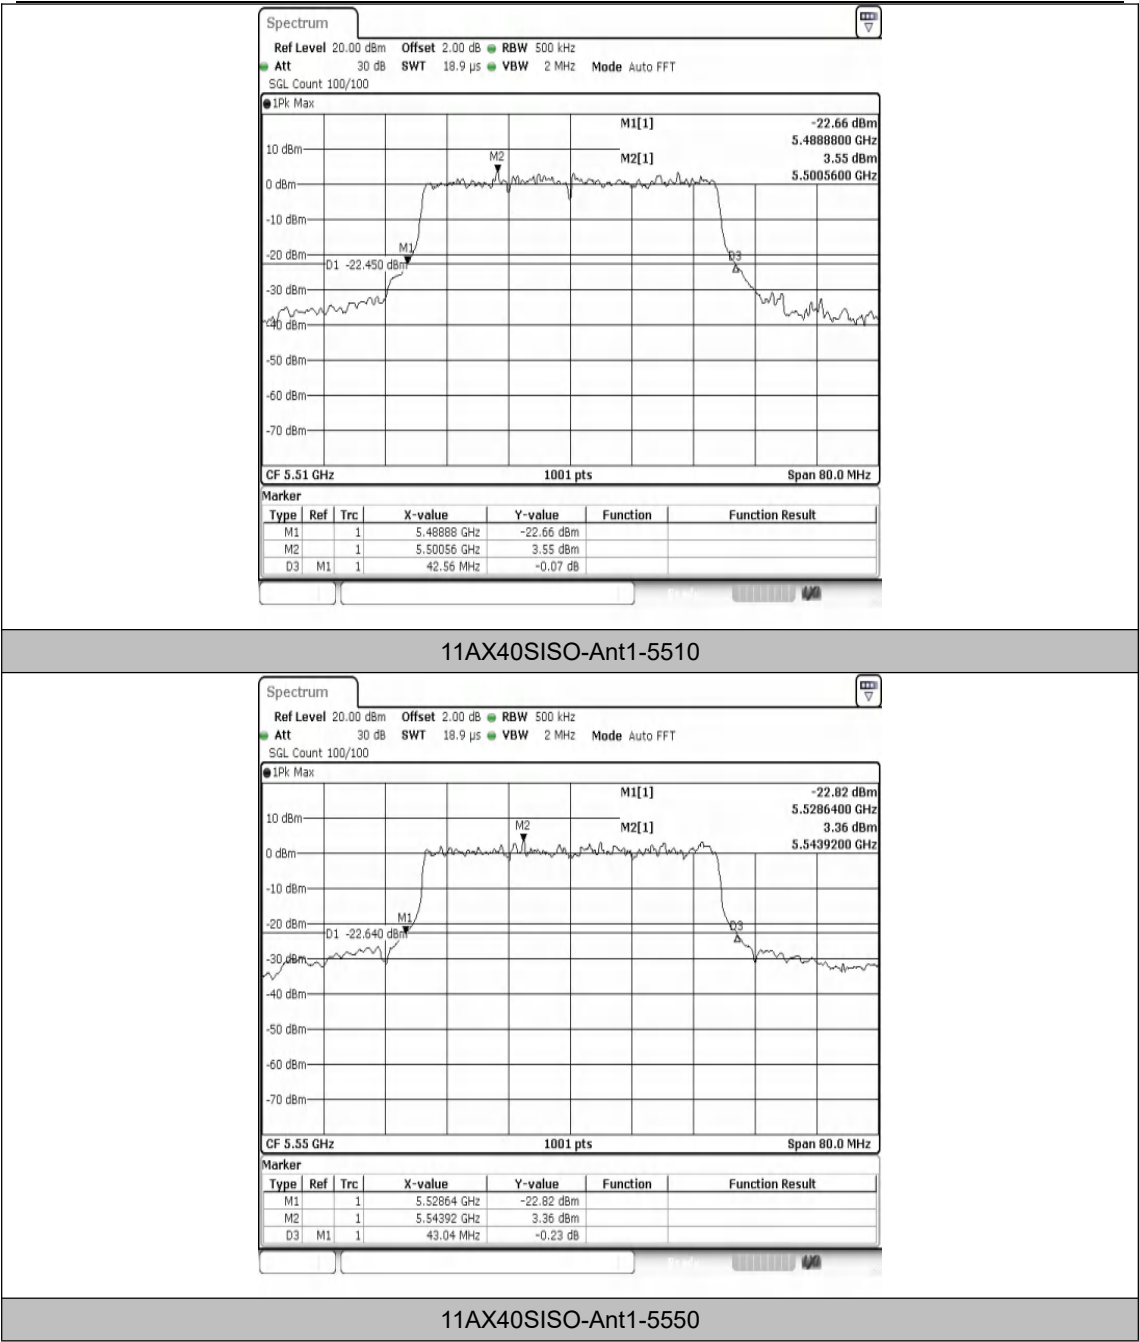

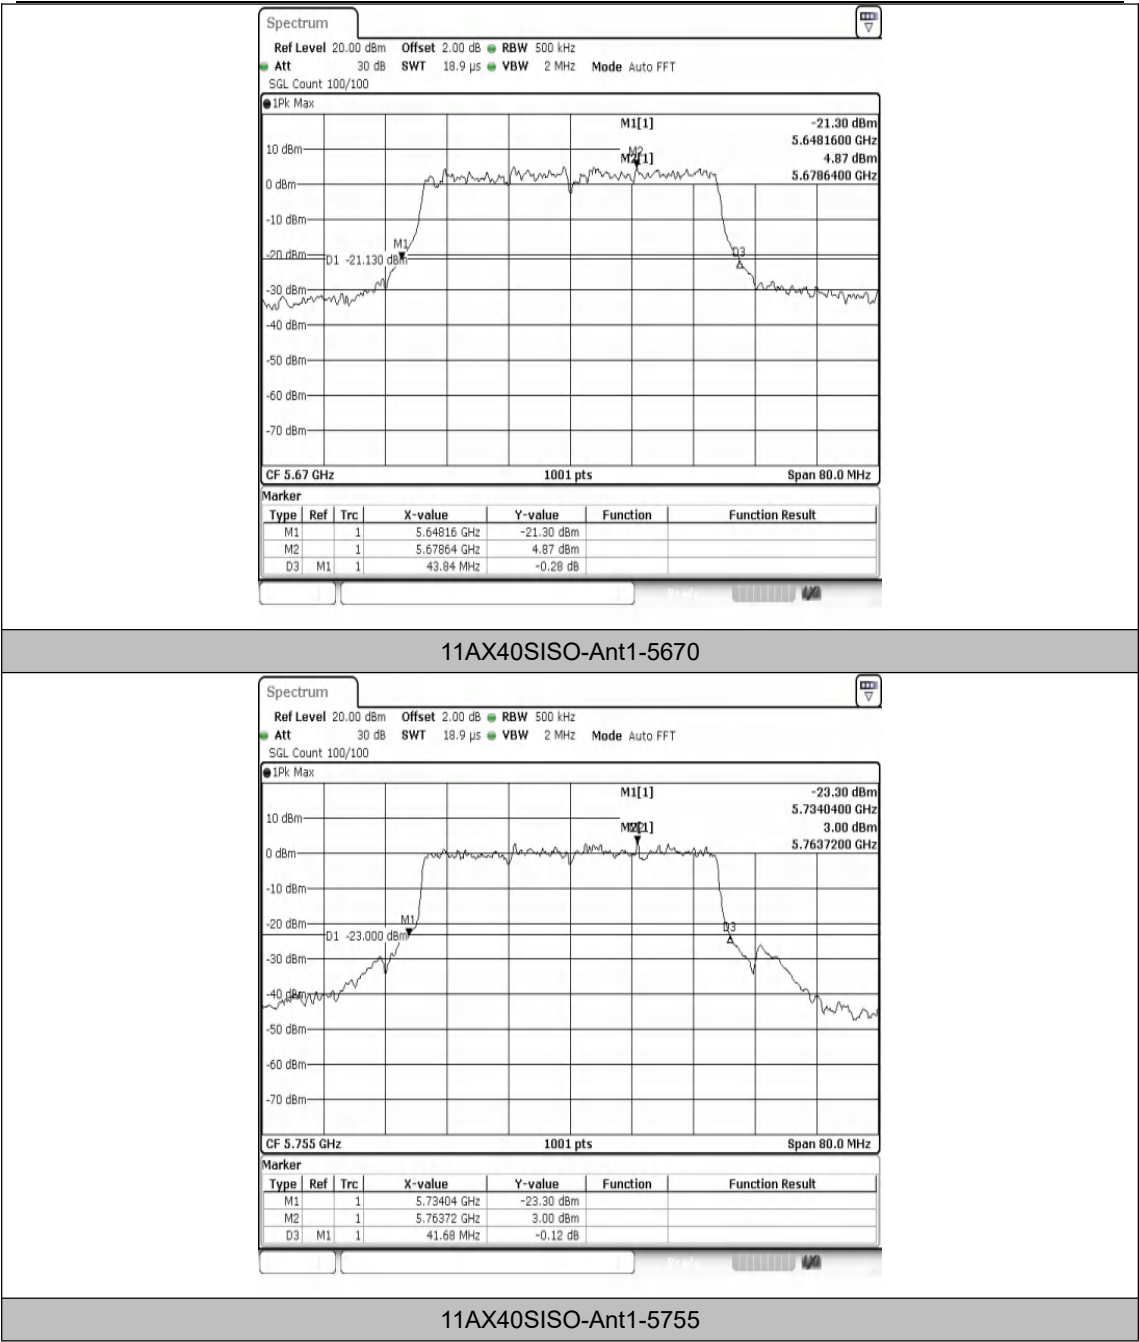

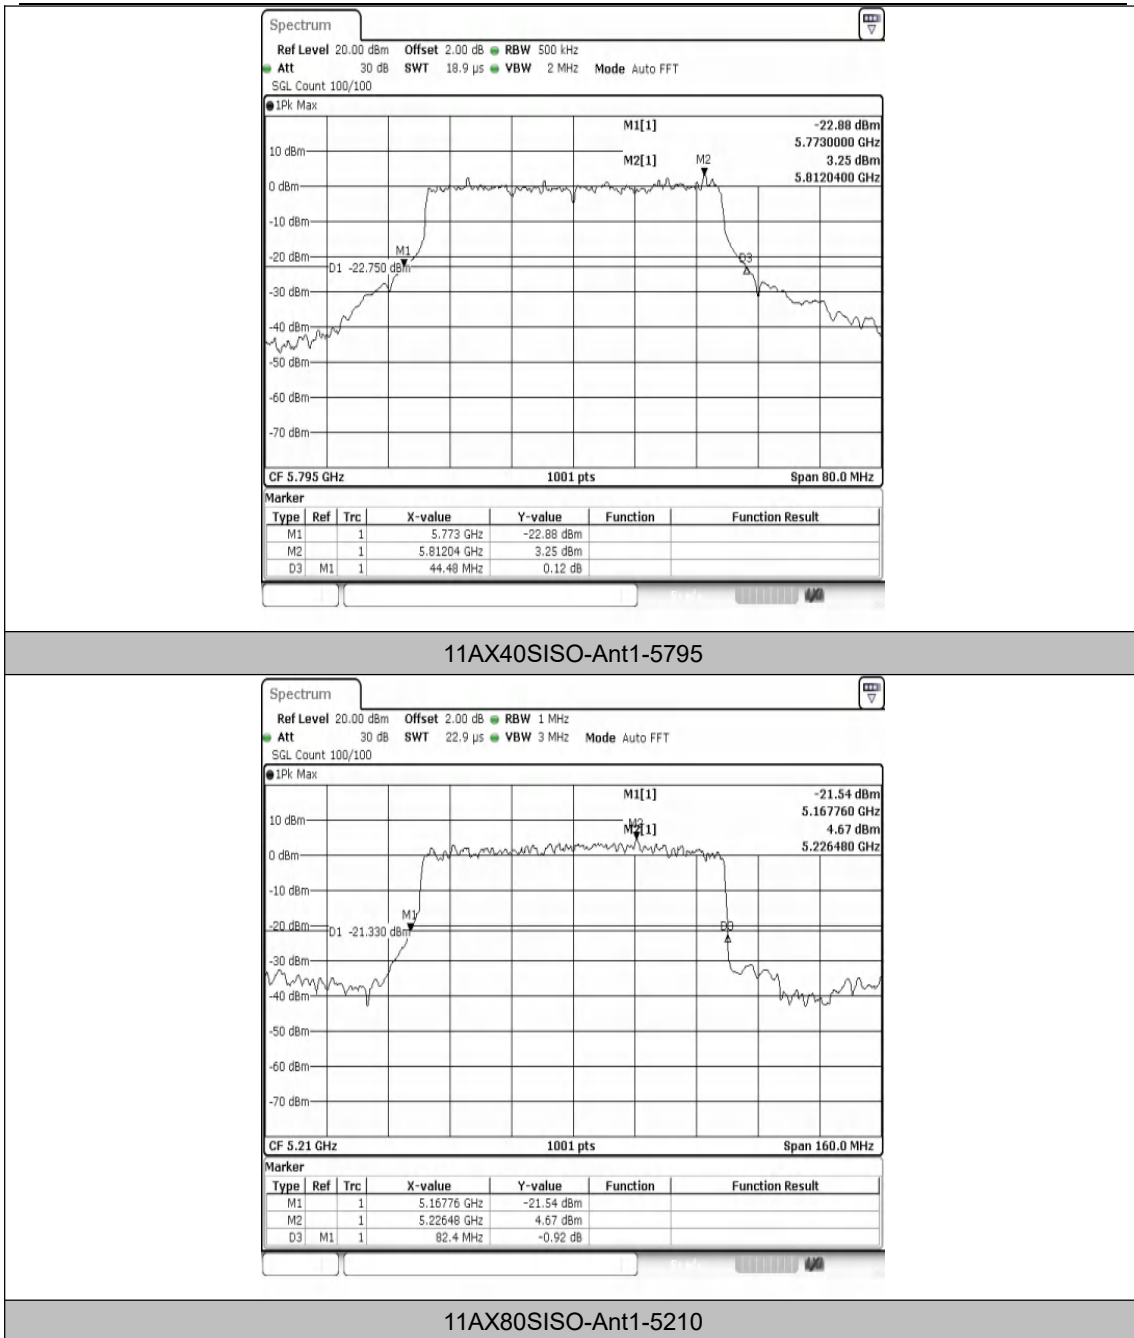

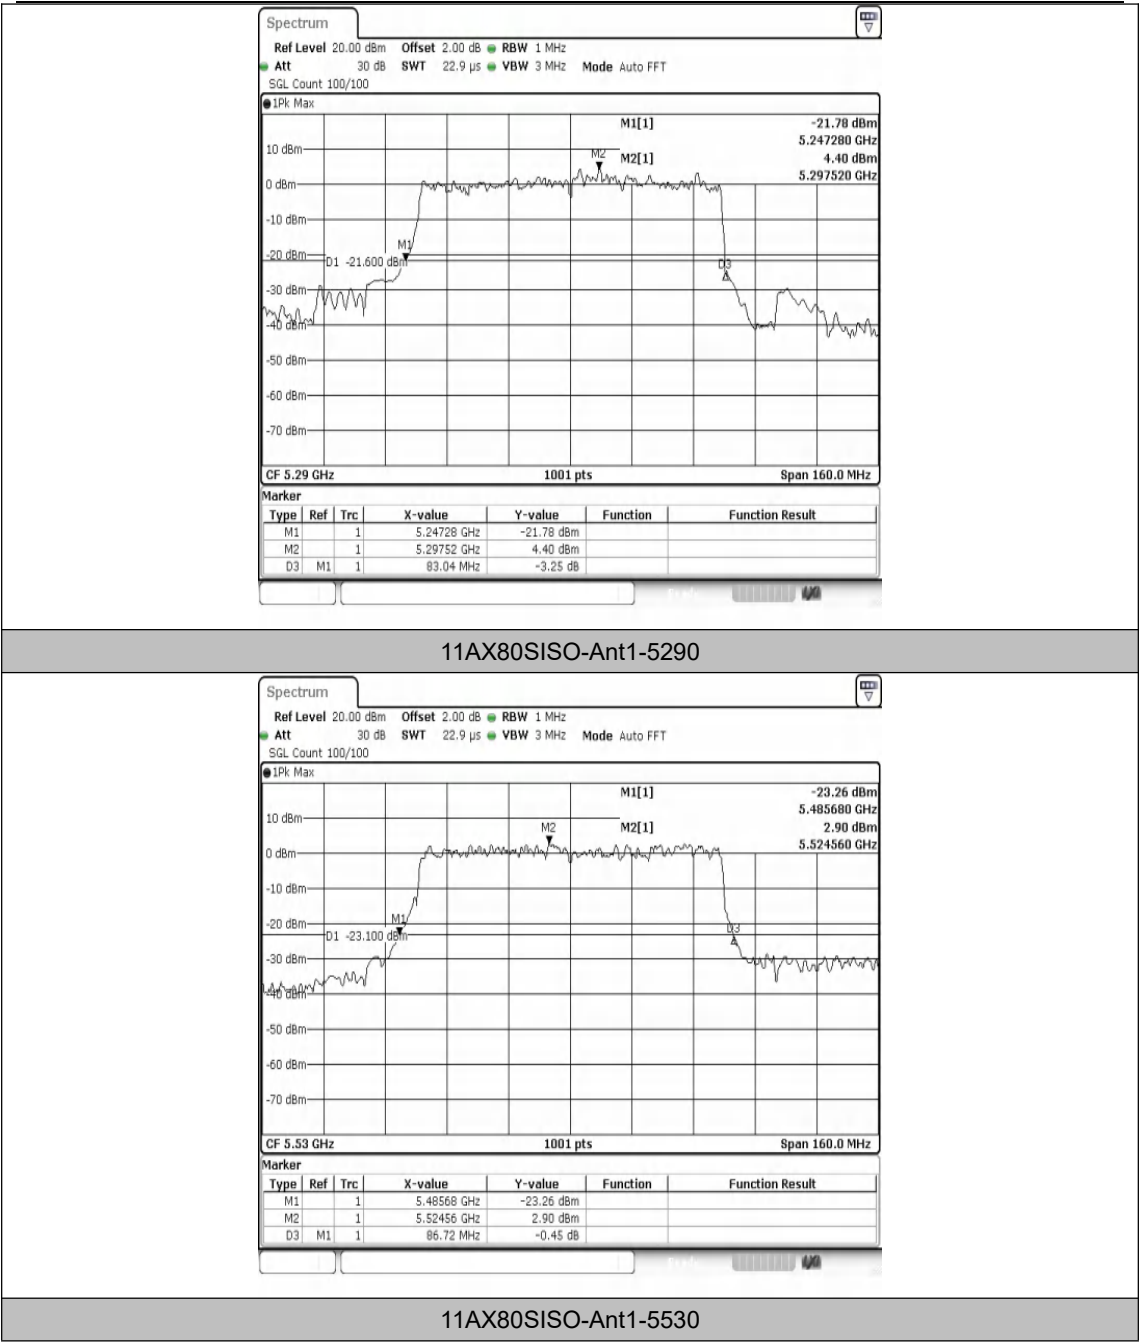



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix A2: 99% Occupied Bandwidth

Test Result

Test Mode	Antenna	Frequency[MHz]	OCB [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5180	17.143	5171.4885	5188.6314	---	---
11A	Ant1	5200	17.263	5191.2088	5208.4715	---	---
11A	Ant1	5240	18.501	5231.1688	5249.6703	---	---
11A	Ant1	5260	17.423	5251.0889	5268.5115	---	---
11A	Ant1	5280	18.541	5270.1698	5288.7113	---	---
11A	Ant1	5320	17.023	5311.6484	5328.6713	---	---
11A	Ant1	5500	17.742	5491.2488	5508.9910	---	---
11A	Ant1	5580	18.102	5570.8092	5588.9111	---	---
11A	Ant1	5700	17.982	5691.1289	5709.1109	---	---
11A	Ant1	5745	17.423	5736.1688	5753.5914	---	---
11A	Ant1	5785	18.262	5775.5295	5793.7912	---	---
11A	Ant1	5825	17.782	5816.0490	5833.8312	---	---
11N20SISO	Ant1	5180	18.621	5170.3297	5188.9510	---	---
11N20SISO	Ant1	5200	18.541	5190.7692	5209.3107	---	---
11N20SISO	Ant1	5240	18.142	5230.7692	5248.9111	---	---
11N20SISO	Ant1	5260	18.661	5250.5295	5269.1908	---	---
11N20SISO	Ant1	5280	18.062	5271.0889	5289.1508	---	---
11N20SISO	Ant1	5320	18.022	5311.0090	5329.0310	---	---
11N20SISO	Ant1	5500	18.701	5490.7692	5509.4705	---	---
11N20SISO	Ant1	5580	18.741	5570.8891	5589.6304	---	---
11N20SISO	Ant1	5700	18.661	5690.7293	5709.3906	---	---
11N20SISO	Ant1	5745	18.581	5735.8891	5754.4705	---	---
11N20SISO	Ant1	5785	19.221	5775.7293	5794.9500	---	---
11N20SISO	Ant1	5825	18.581	5815.7293	5834.3107	---	---
11N40SISO	Ant1	5190	37.163	5171.3786	5208.5415	---	---
11N40SISO	Ant1	5230	36.603	5211.8581	5248.4615	---	---
11N40SISO	Ant1	5270	36.763	5251.5385	5288.3017	---	---
11N40SISO	Ant1	5310	36.284	5291.9381	5328.2218	---	---
11N40SISO	Ant1	5510	37.403	5491.5385	5528.9411	---	---
11N40SISO	Ant1	5550	37.562	5531.4585	5569.0210	---	---
11N40SISO	Ant1	5670	37.962	5651.2987	5689.2607	---	---
11N40SISO	Ant1	5755	36.683	5736.6983	5773.3816	---	---
11N40SISO	Ant1	5795	37.003	5776.4585	5813.4615	---	---
11AC20SISO	Ant1	5180	18.621	5170.9291	5189.5504	---	---
11AC20SISO	Ant1	5200	18.781	5190.9690	5209.7502	---	---
11AC20SISO	Ant1	5240	18.382	5230.6094	5248.9910	---	---
11AC20SISO	Ant1	5260	18.462	5250.7293	5269.1908	---	---

11AC20SISO	Ant1	5280	18.661	5270.7692	5289.4306	---	---
11AC20SISO	Ant1	5320	18.382	5310.7692	5329.1508	---	---
11AC20SISO	Ant1	5500	19.261	5490.6494	5509.9101	---	---
11AC20SISO	Ant1	5580	18.621	5571.0889	5589.7103	---	---
11AC20SISO	Ant1	5700	18.901	5690.6893	5709.5904	---	---
11AC20SISO	Ant1	5745	19.341	5735.6893	5755.0300	---	---
11AC20SISO	Ant1	5785	18.941	5775.6494	5794.5904	---	---
11AC20SISO	Ant1	5825	18.661	5815.7293	5834.3906	---	---
11AC40SISO	Ant1	5190	37.083	5171.4585	5208.5415	---	---
11AC40SISO	Ant1	5230	37.483	5211.2188	5248.7013	---	---
11AC40SISO	Ant1	5270	36.683	5251.5385	5288.2218	---	---
11AC40SISO	Ant1	5310	36.364	5291.8581	5328.2218	---	---
11AC40SISO	Ant1	5510	36.683	5491.5385	5528.2218	---	---
11AC40SISO	Ant1	5550	36.763	5531.7782	5568.5415	---	---
11AC40SISO	Ant1	5670	37.802	5651.4585	5689.2607	---	---
11AC40SISO	Ant1	5755	36.763	5736.6983	5773.4615	---	---
11AC40SISO	Ant1	5795	37.642	5775.8991	5813.5415	---	---
11AC80SISO	Ant1	5210	76.084	5171.7982	5247.8821	---	---
11AC80SISO	Ant1	5290	76.563	5251.6384	5328.2018	---	---
11AC80SISO	Ant1	5530	77.043	5491.7982	5568.8412	---	---
11AC80SISO	Ant1	5775	76.244	5736.9580	5813.2018	---	---
11AX20SISO	Ant1	5180	19.900	5170.3297	5190.2298	---	---
11AX20SISO	Ant1	5200	19.221	5190.4096	5209.6304	---	---
11AX20SISO	Ant1	5240	19.301	5230.2897	5249.5904	---	---
11AX20SISO	Ant1	5260	20.300	5250.2098	5270.5095	---	---
11AX20SISO	Ant1	5280	19.101	5270.4096	5289.5105	---	---
11AX20SISO	Ant1	5320	19.221	5310.5295	5329.7502	---	---
11AX20SISO	Ant1	5500	19.341	5490.3696	5509.7103	---	---
11AX20SISO	Ant1	5580	19.540	5570.2498	5589.7902	---	---
11AX20SISO	Ant1	5700	19.540	5690.4496	5709.9900	---	---
11AX20SISO	Ant1	5745	20.100	5735.4496	5755.5495	---	---
11AX20SISO	Ant1	5785	19.221	5775.4496	5794.6703	---	---
11AX20SISO	Ant1	5825	19.500	5815.3696	5834.8701	---	---
11AX40SISO	Ant1	5190	38.122	5170.8991	5209.0210	---	---
11AX40SISO	Ant1	5230	38.202	5210.8991	5249.1009	---	---
11AX40SISO	Ant1	5270	38.202	5250.8192	5289.0210	---	---
11AX40SISO	Ant1	5310	38.282	5290.8192	5329.1009	---	---
11AX40SISO	Ant1	5510	38.362	5490.8192	5529.1808	---	---
11AX40SISO	Ant1	5550	38.681	5530.2597	5568.9411	---	---
11AX40SISO	Ant1	5670	38.202	5651.0589	5689.2607	---	---
11AX40SISO	Ant1	5755	38.202	5735.8991	5774.1009	---	---
11AX40SISO	Ant1	5795	38.202	5776.0589	5814.2607	---	---

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


11AX80SISO	Ant1	5210	77.522	5171.1588	5248.6813	---	---
11AX80SISO	Ant1	5290	77.522	5251.3187	5328.8412	---	---
11AX80SISO	Ant1	5530	78.322	5490.9990	5569.3207	---	---
11AX80SISO	Ant1	5775	77.842	5736.3187	5814.1608	---	---


Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Test Graphs

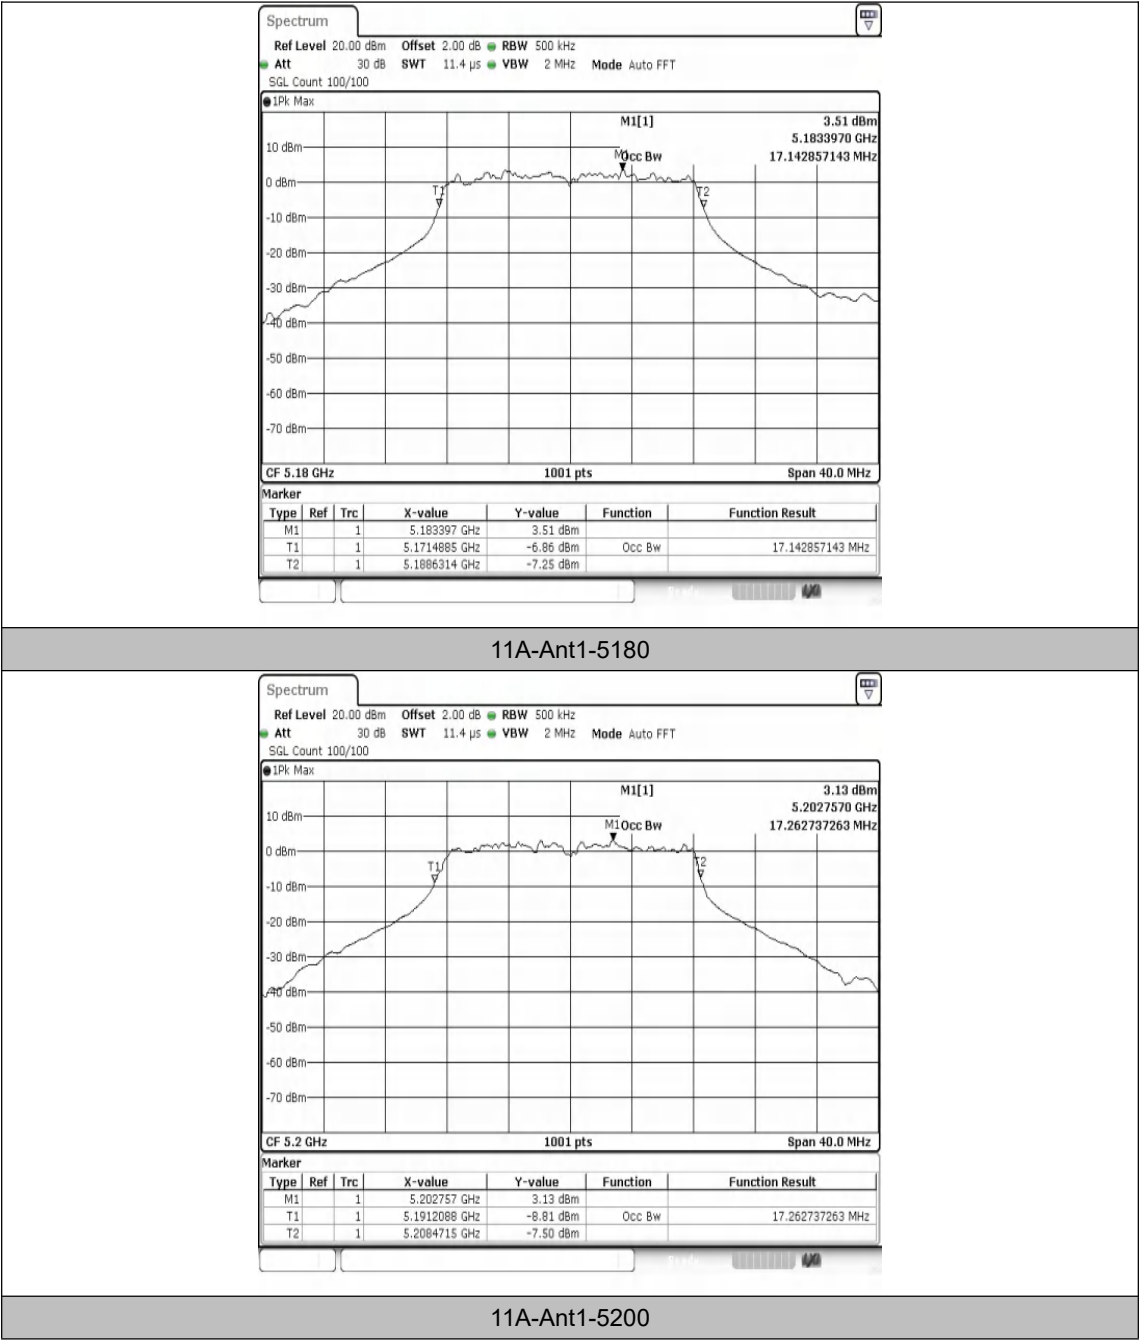

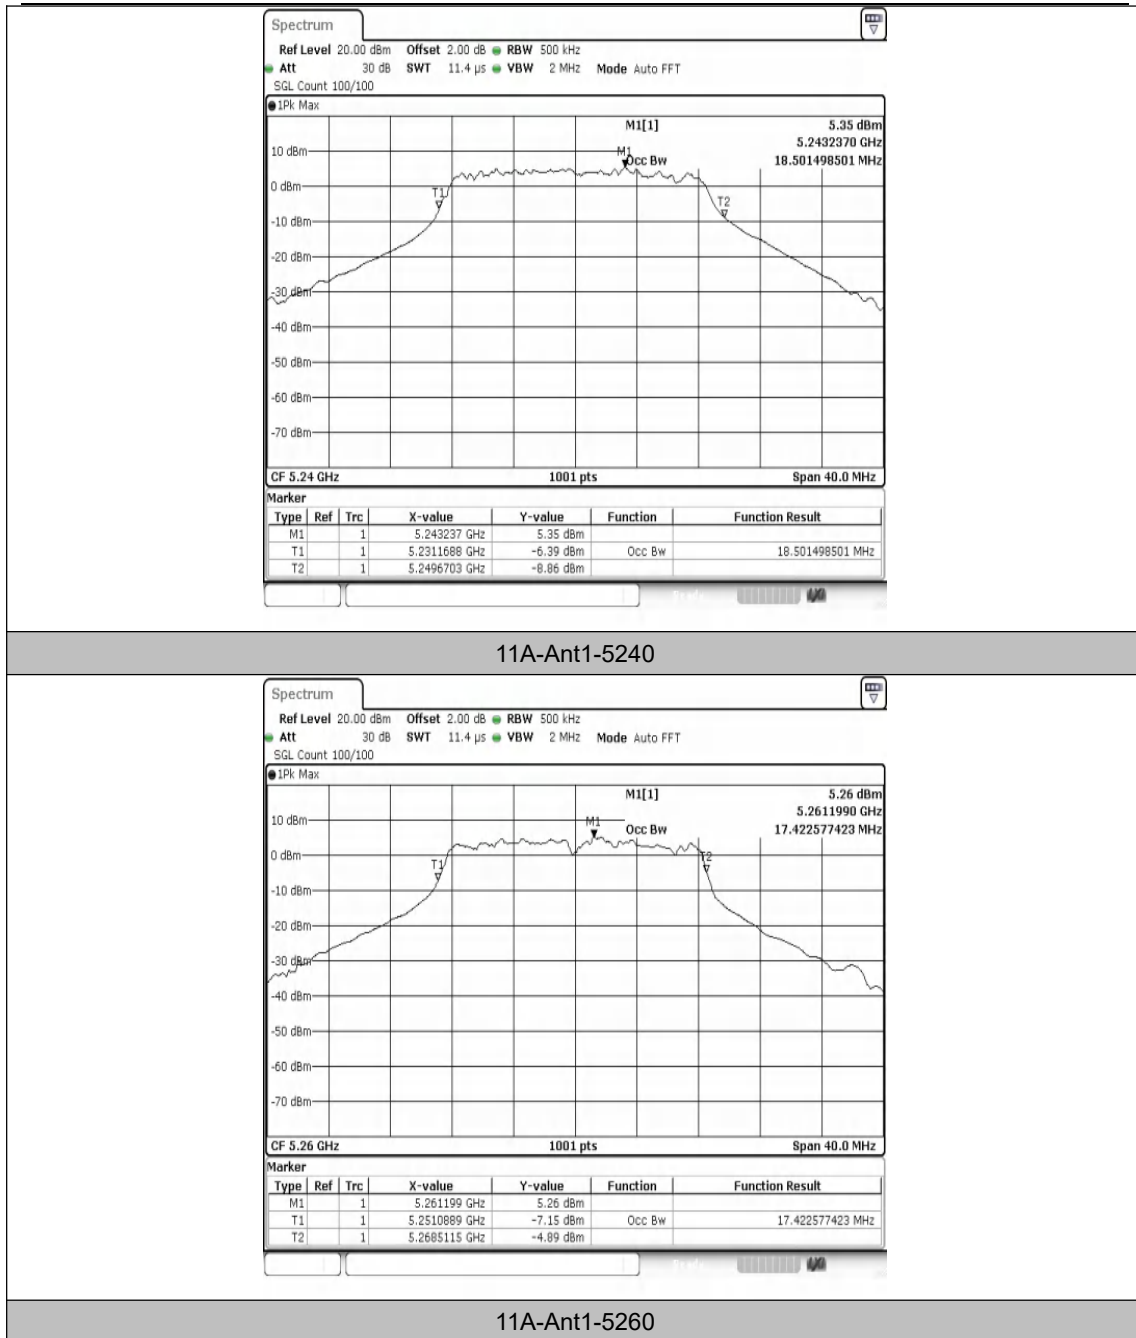

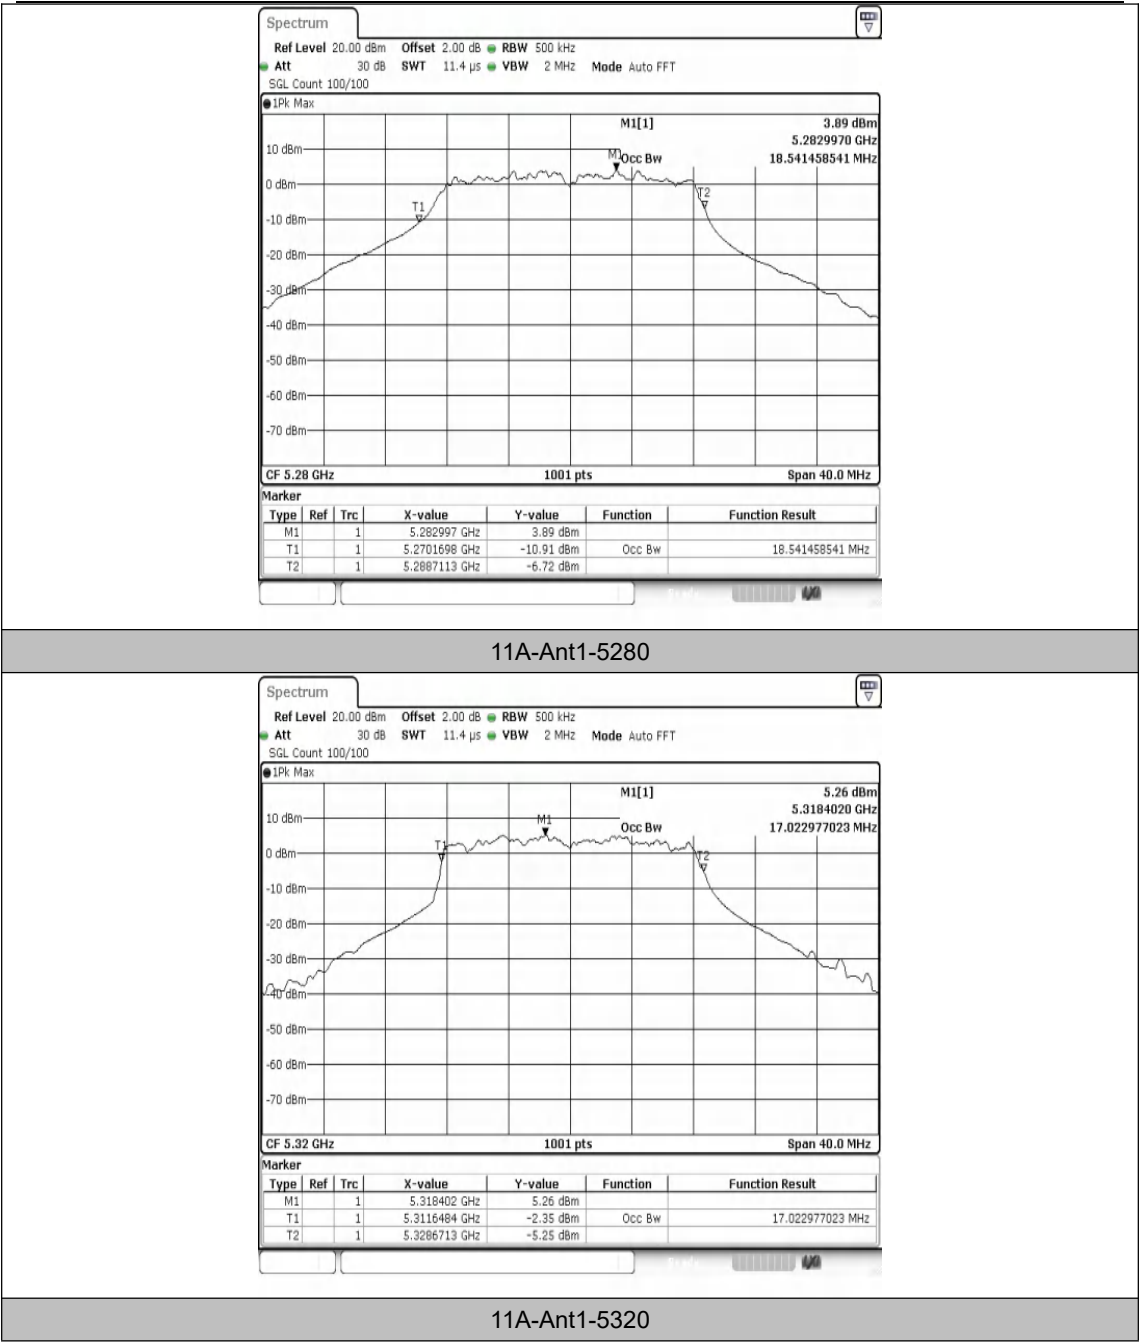

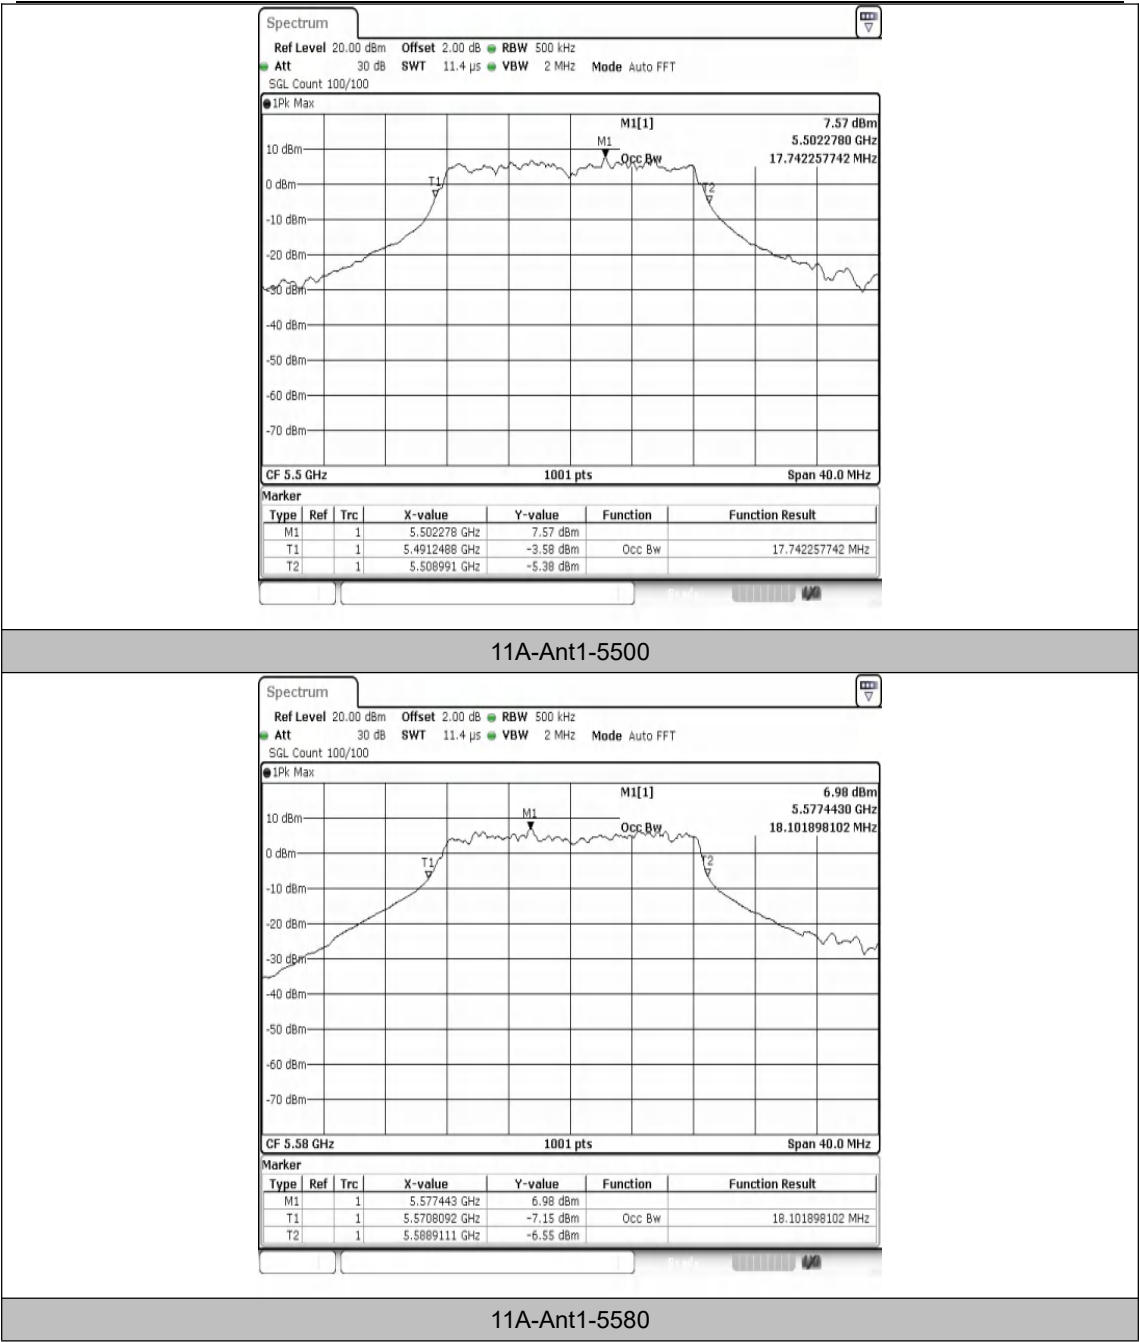


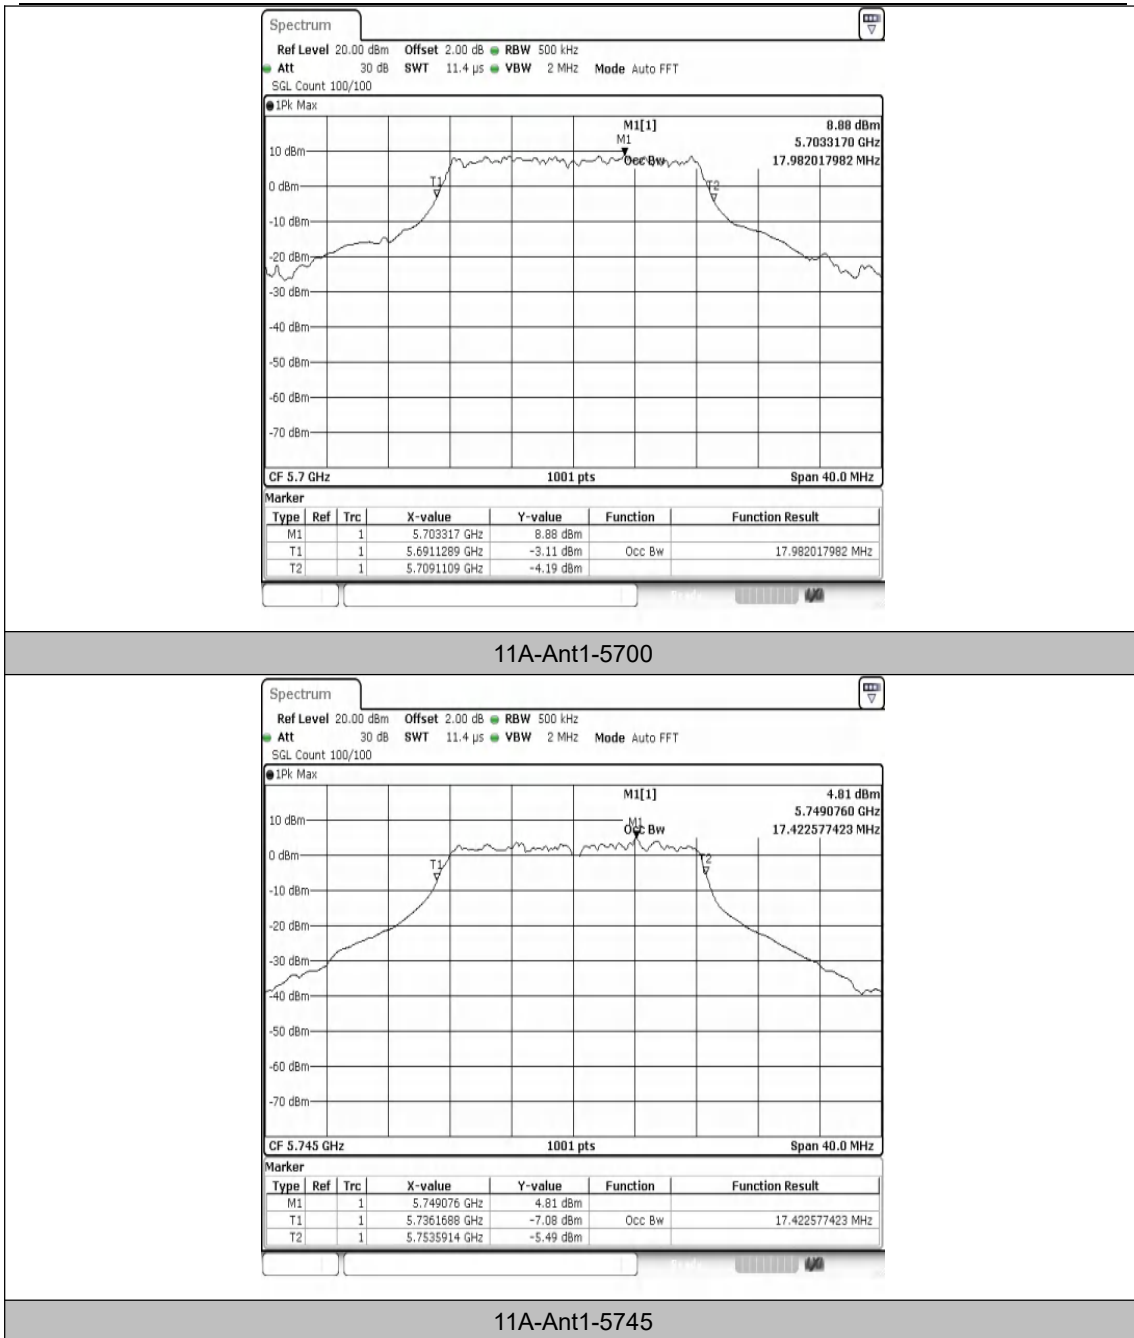



Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

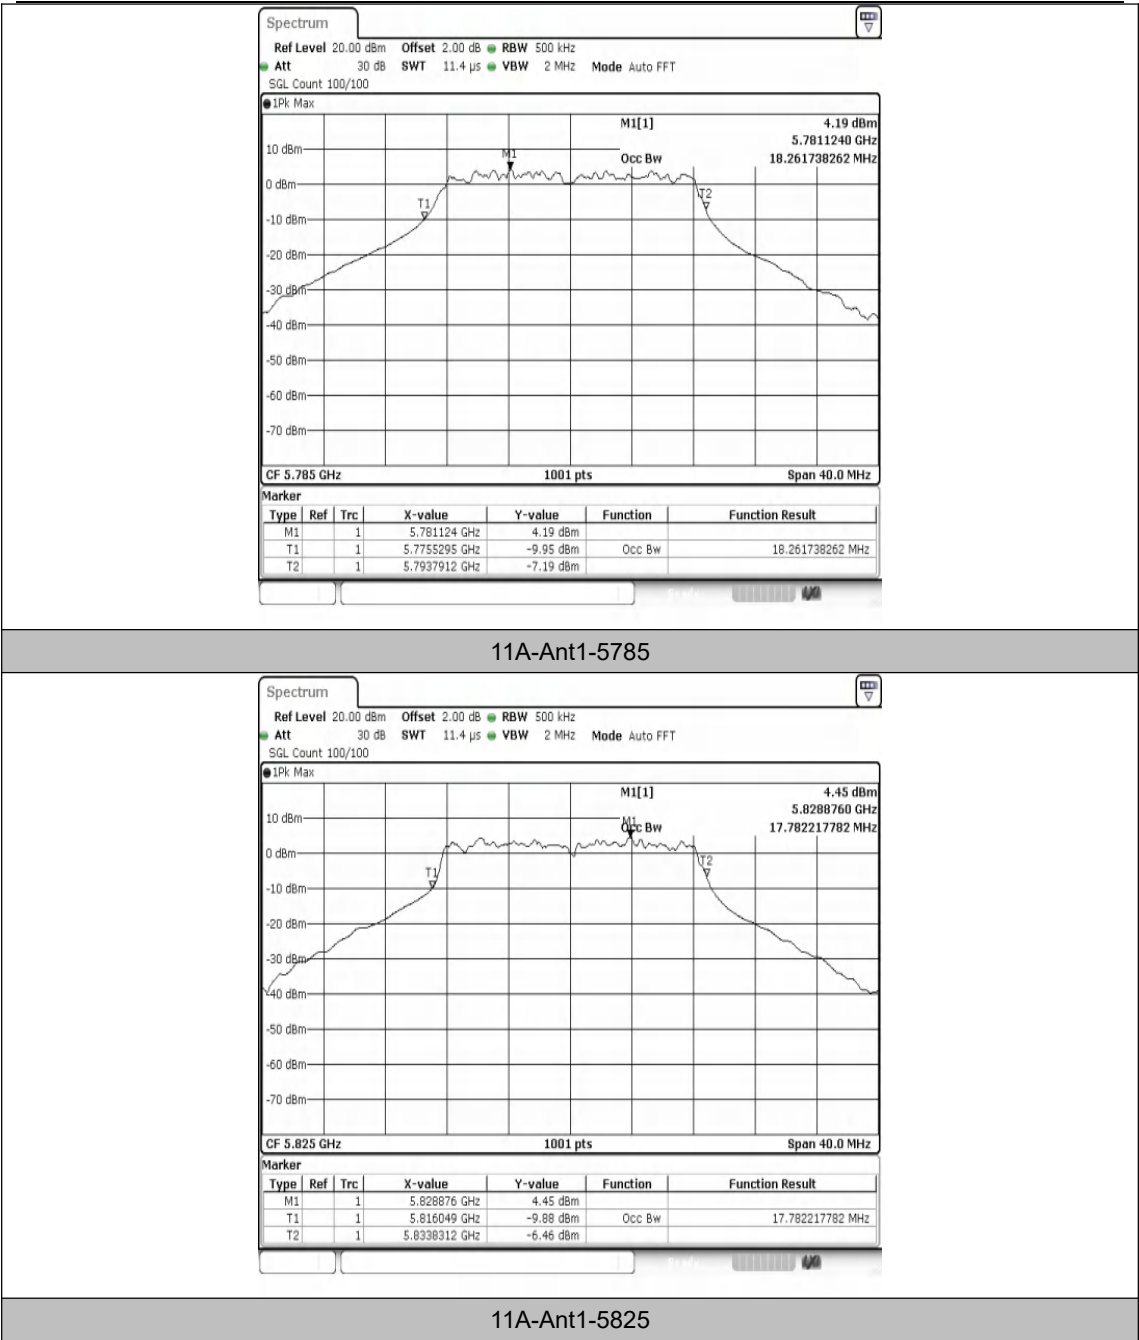


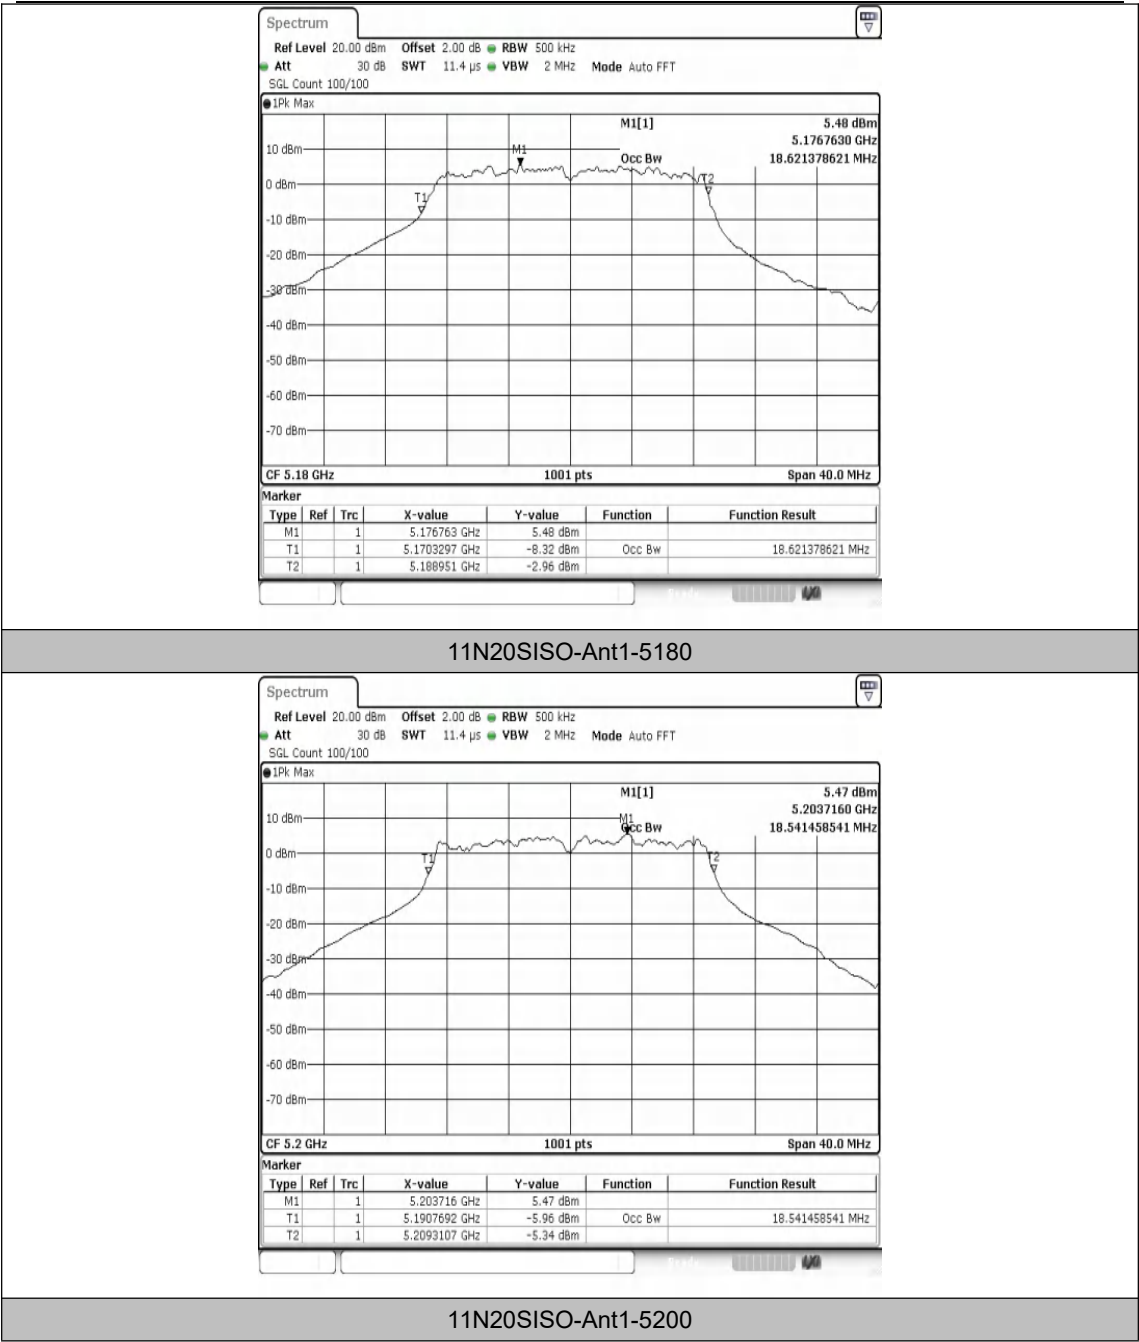


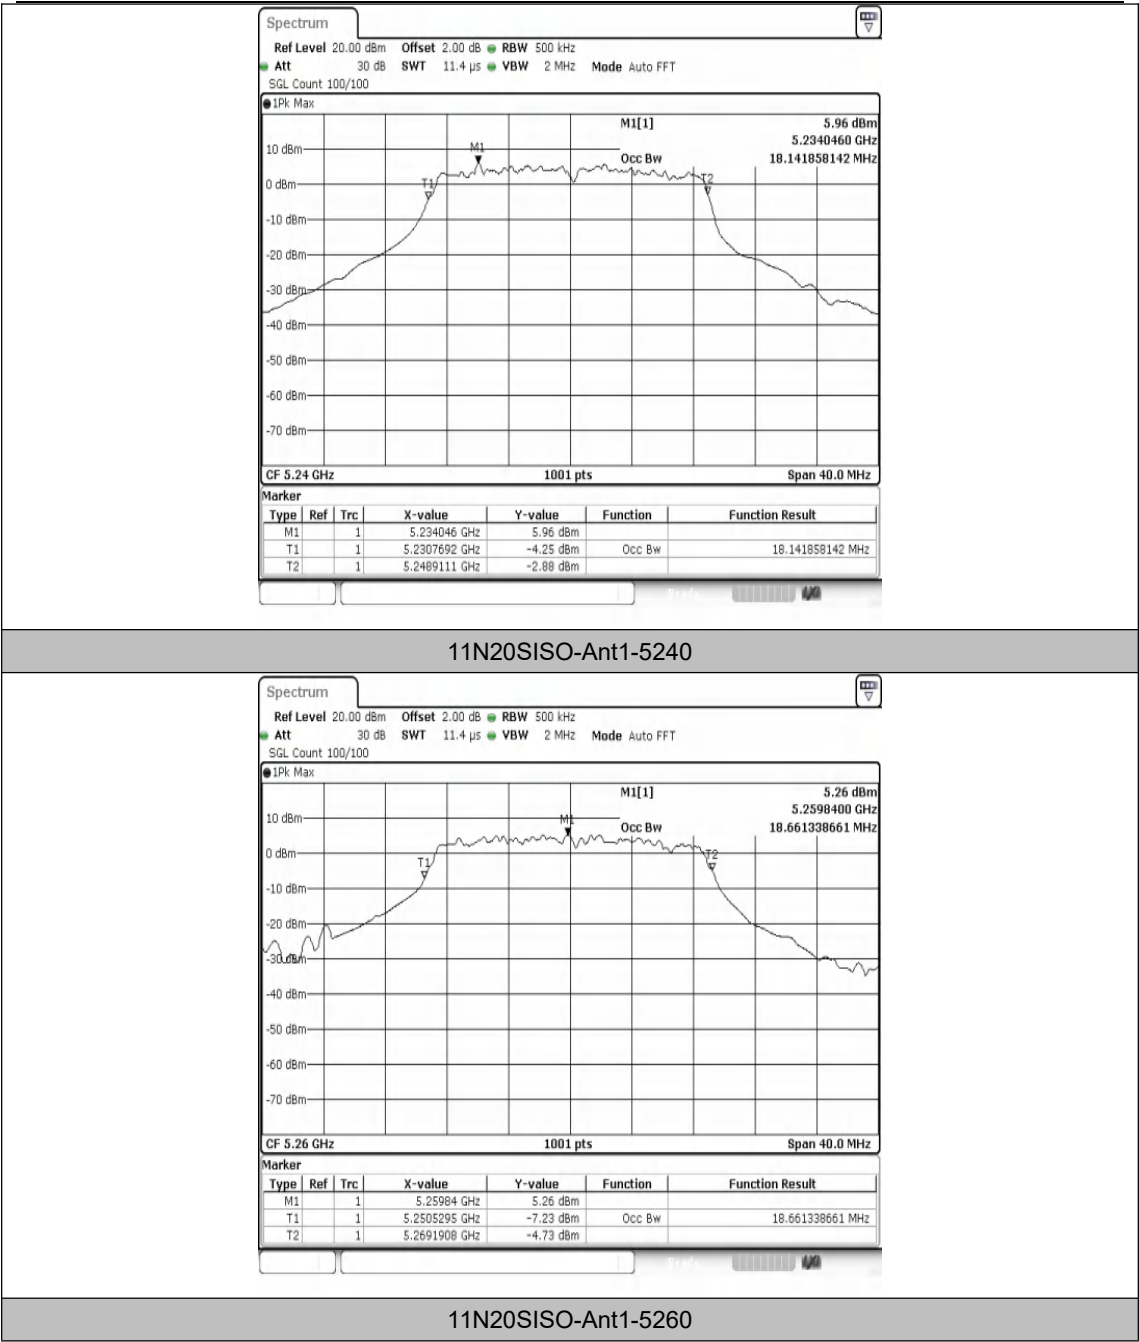


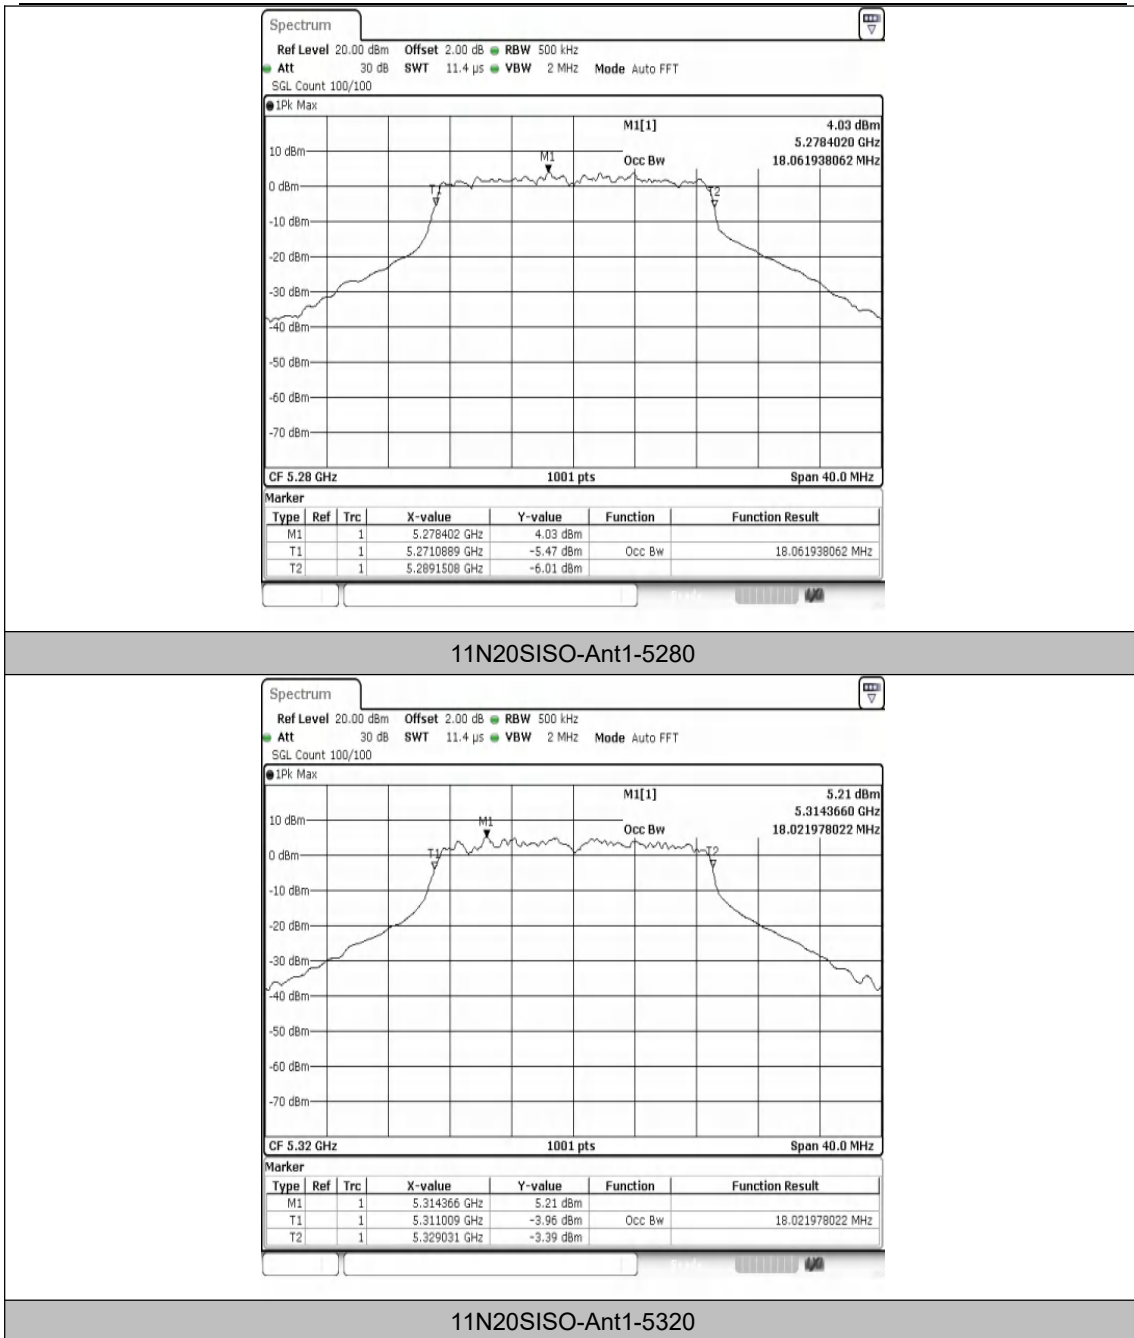


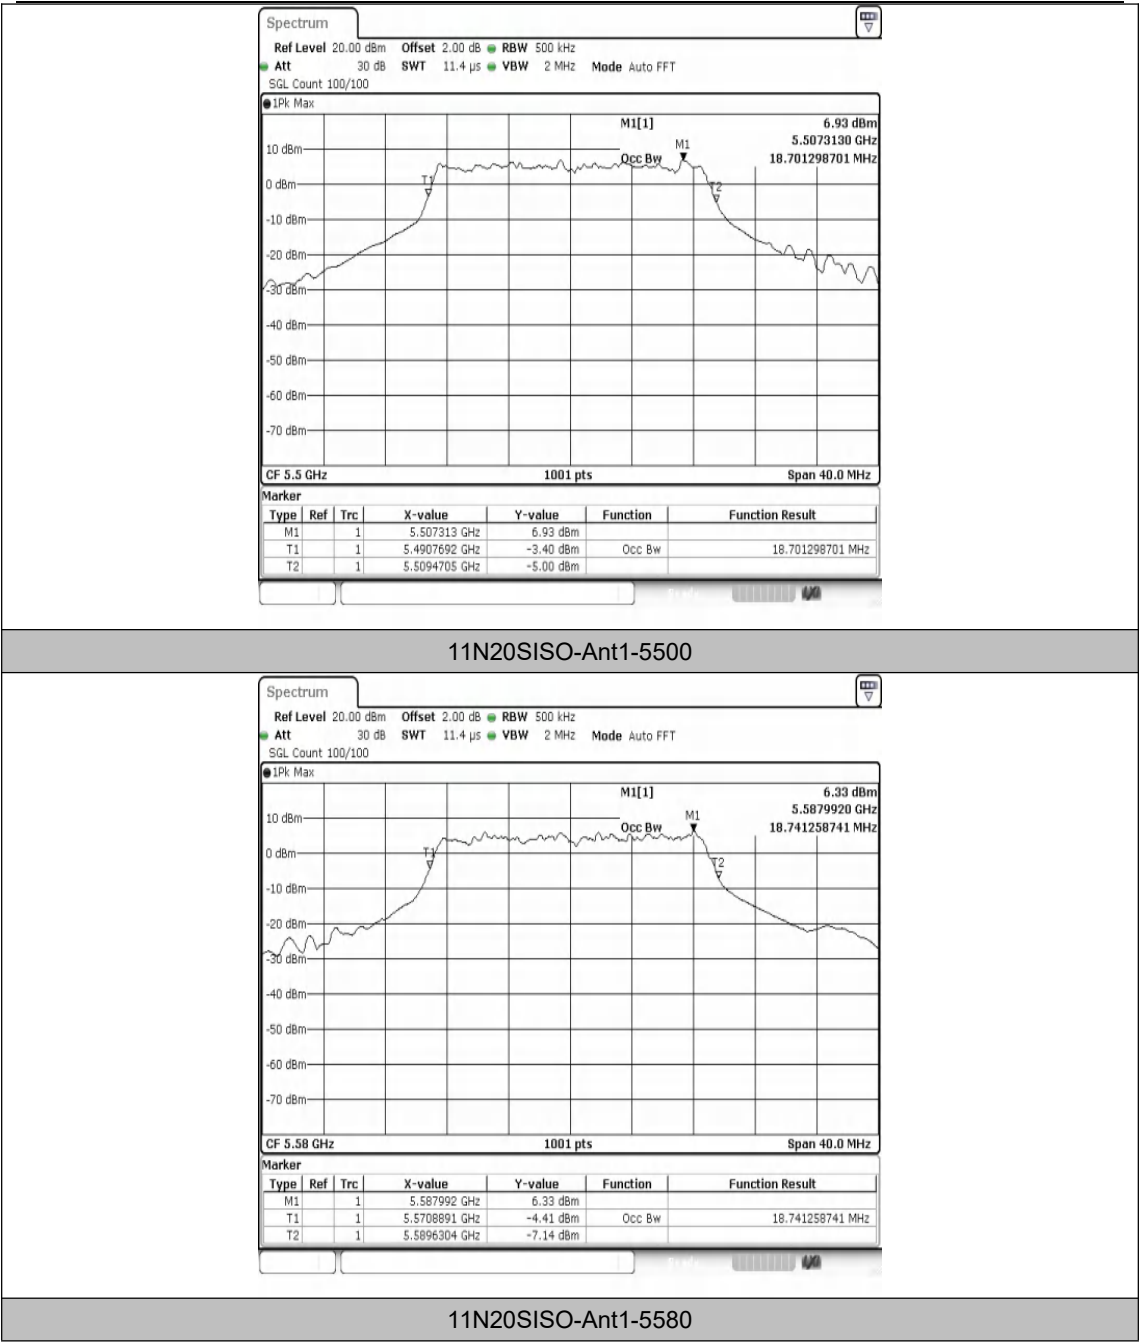


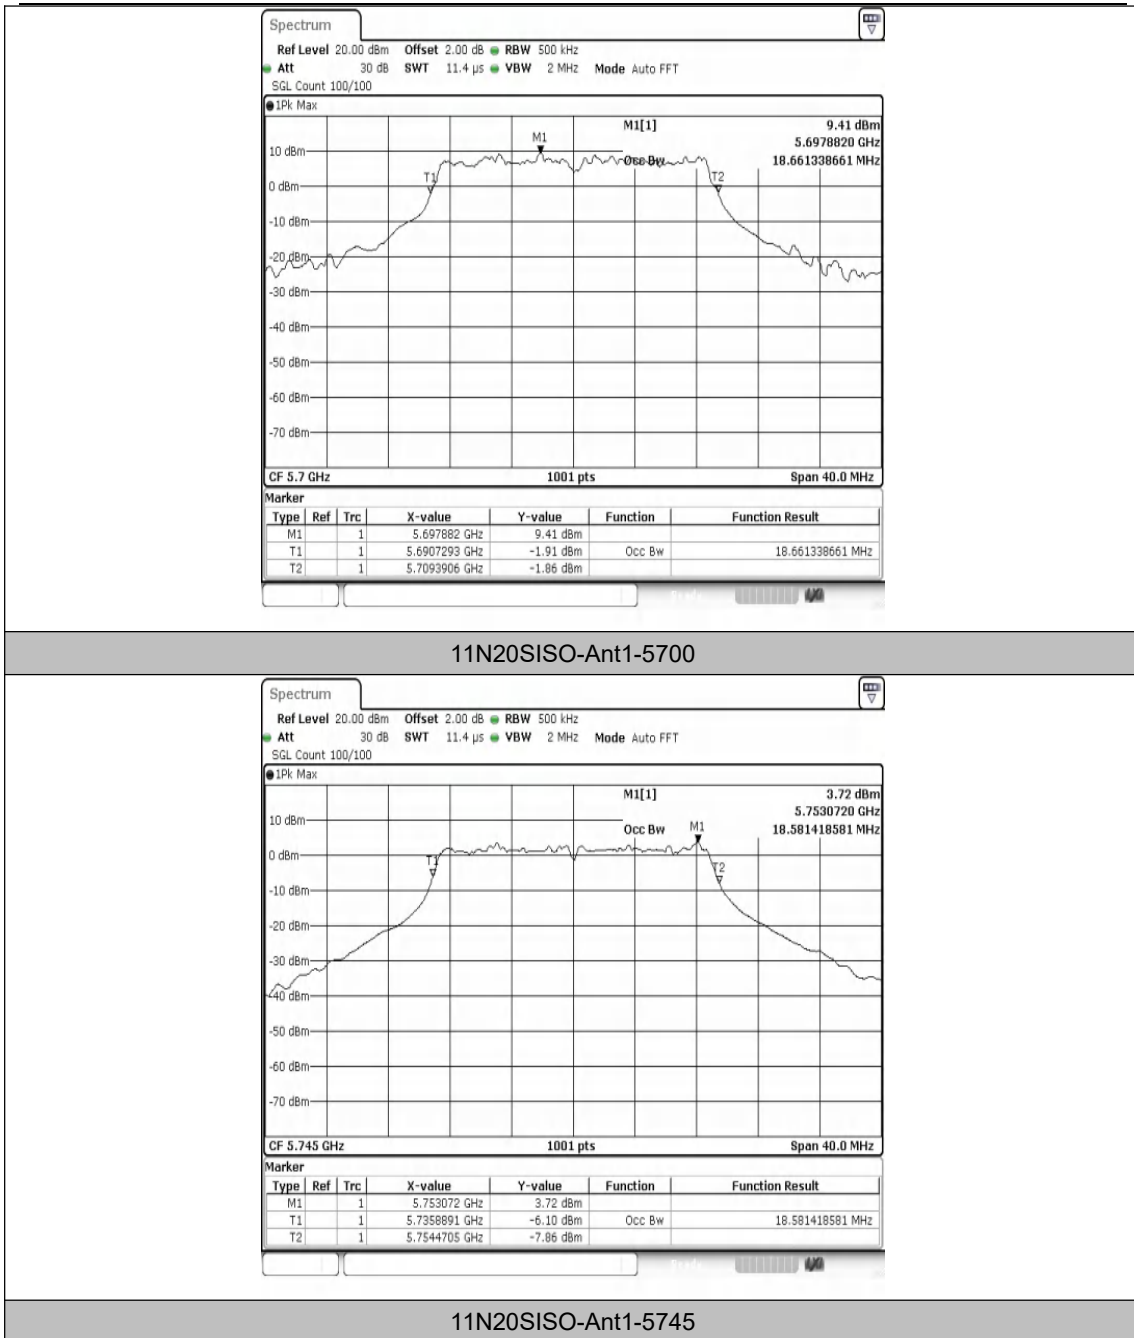


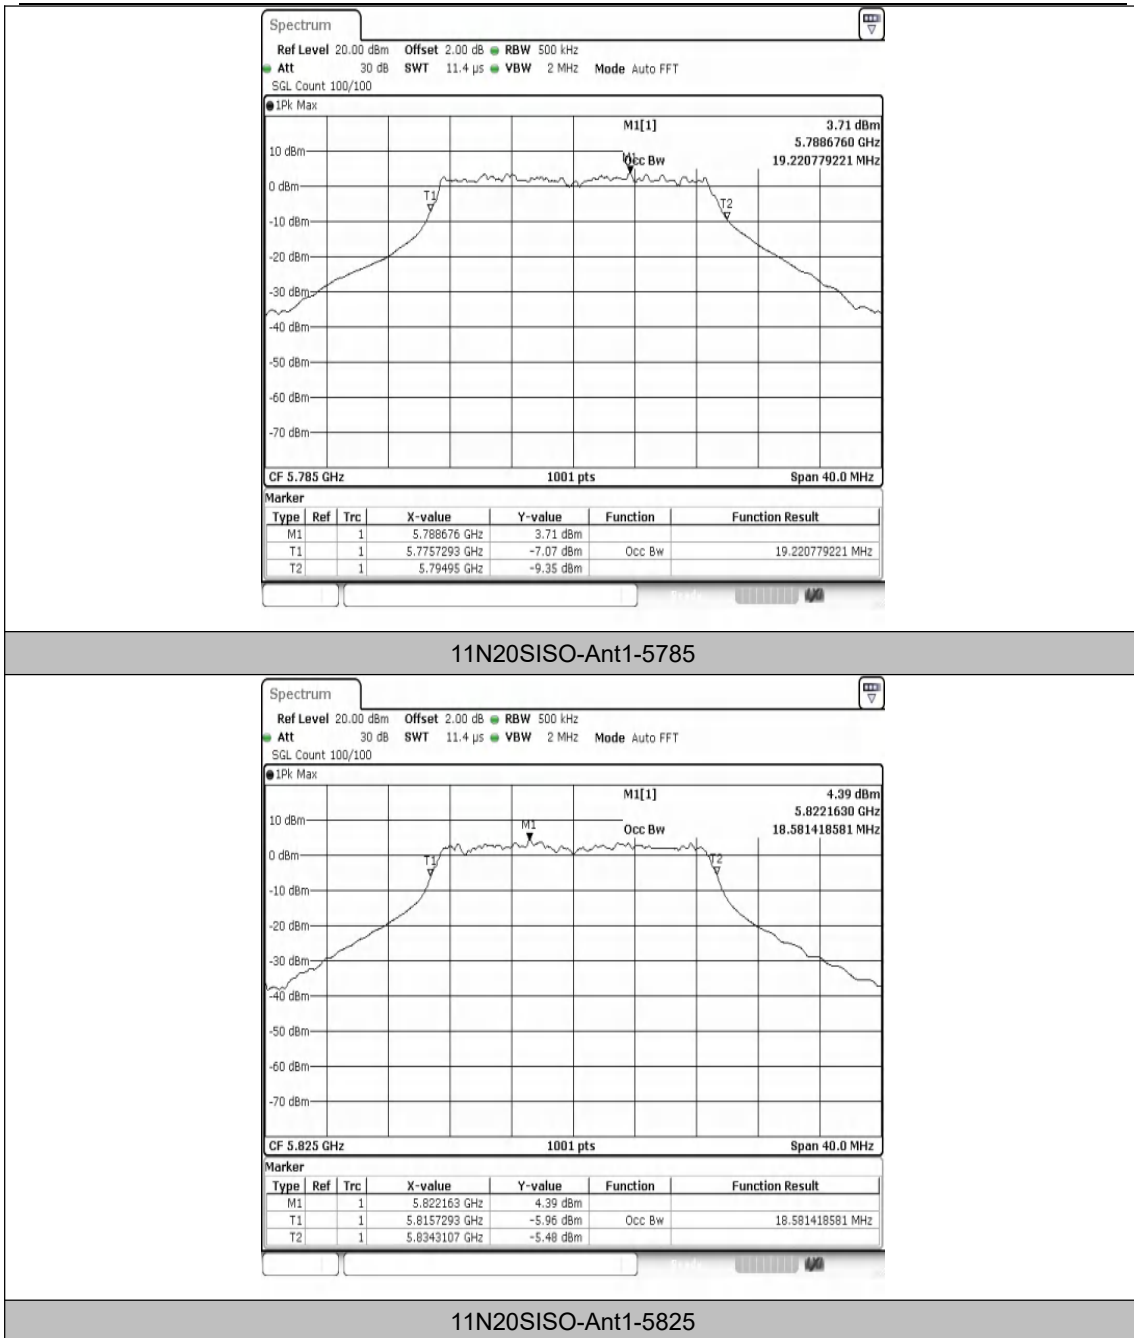


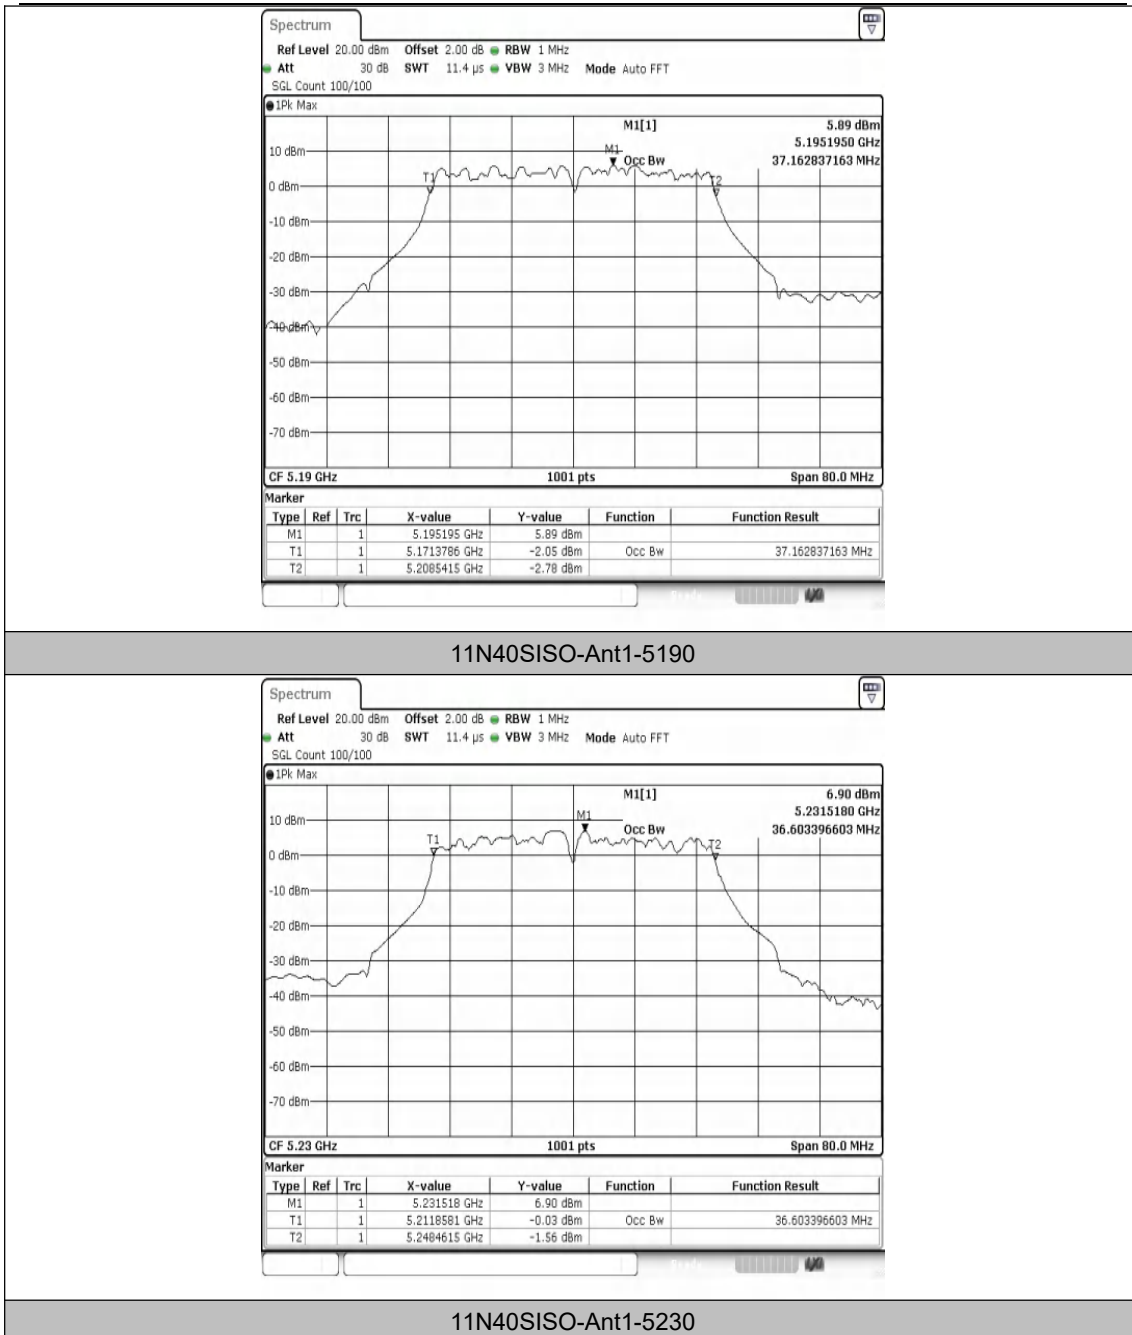


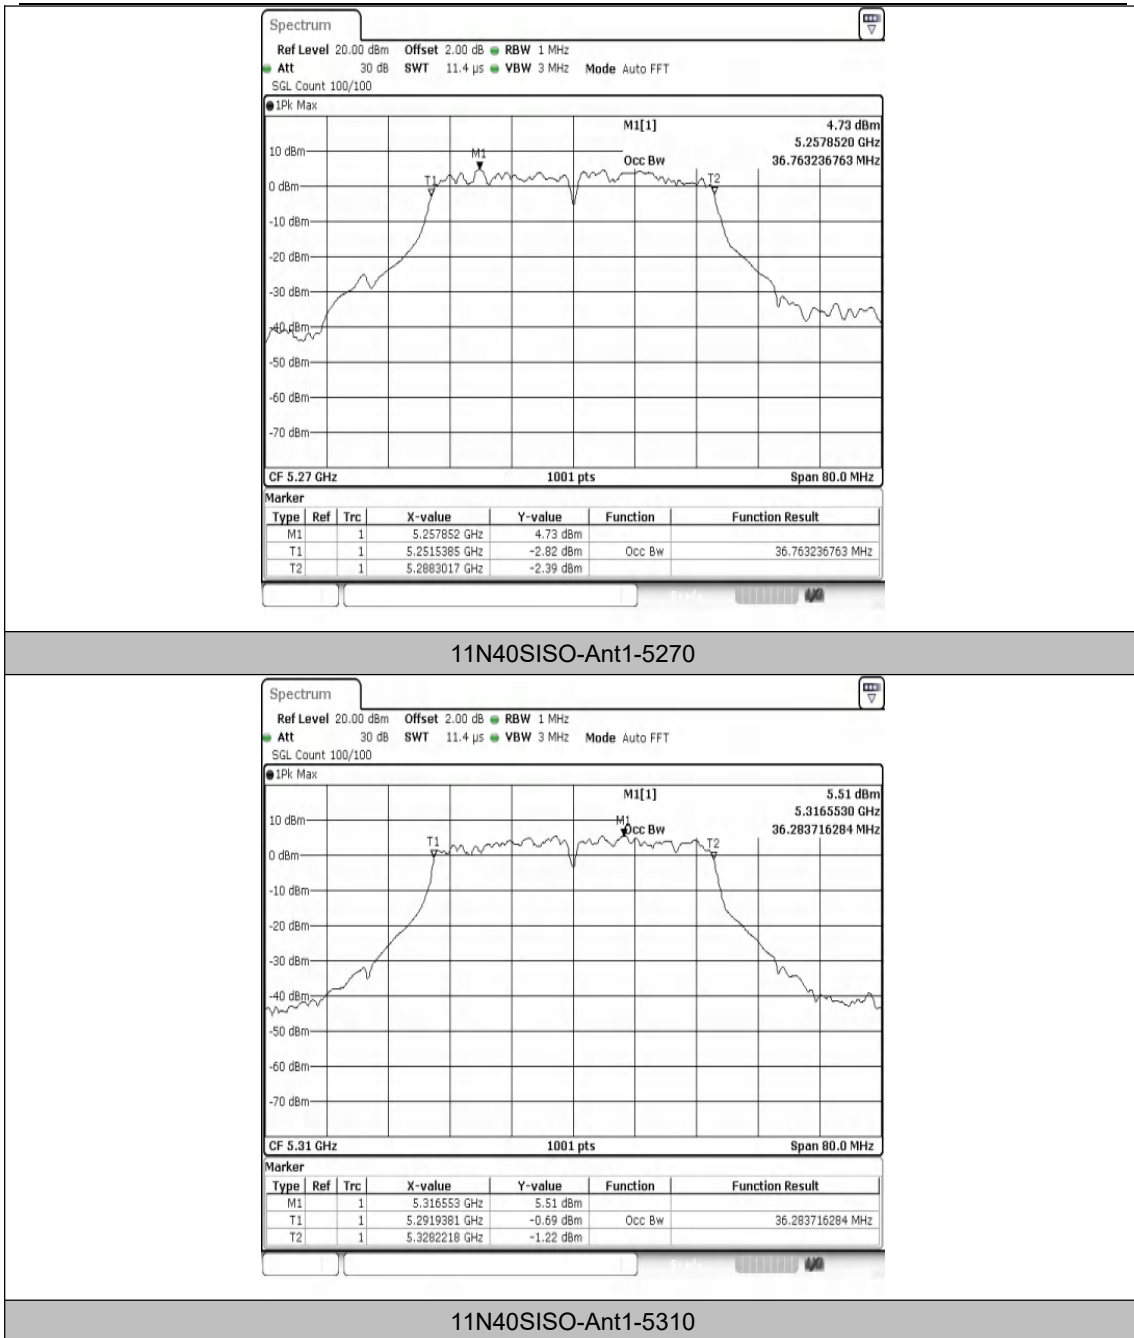


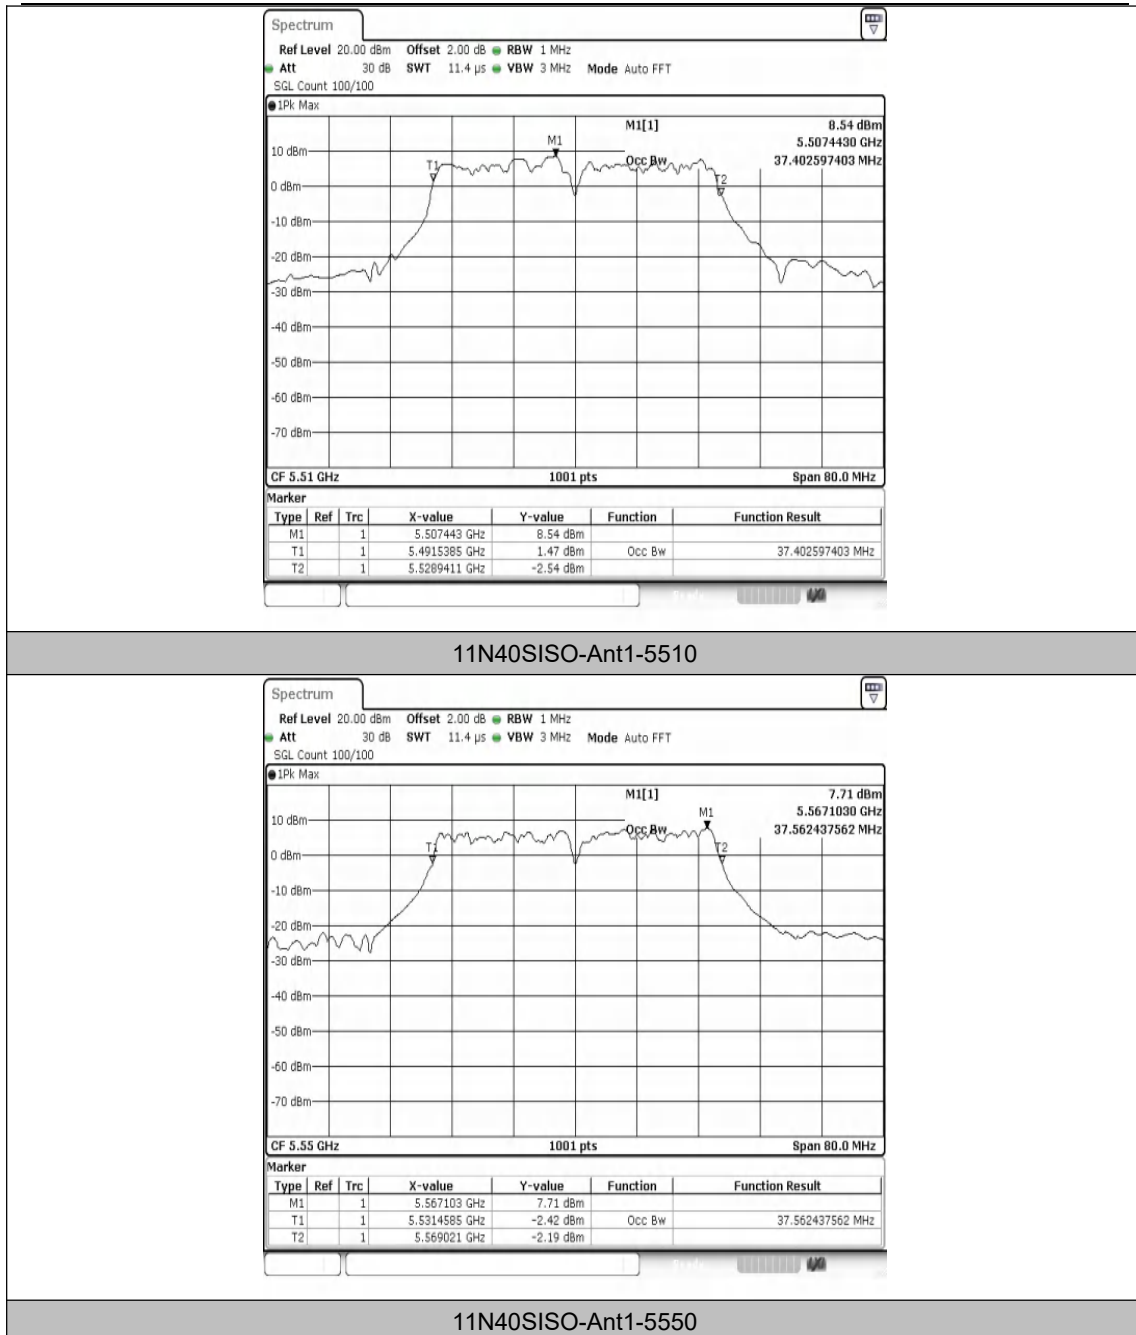


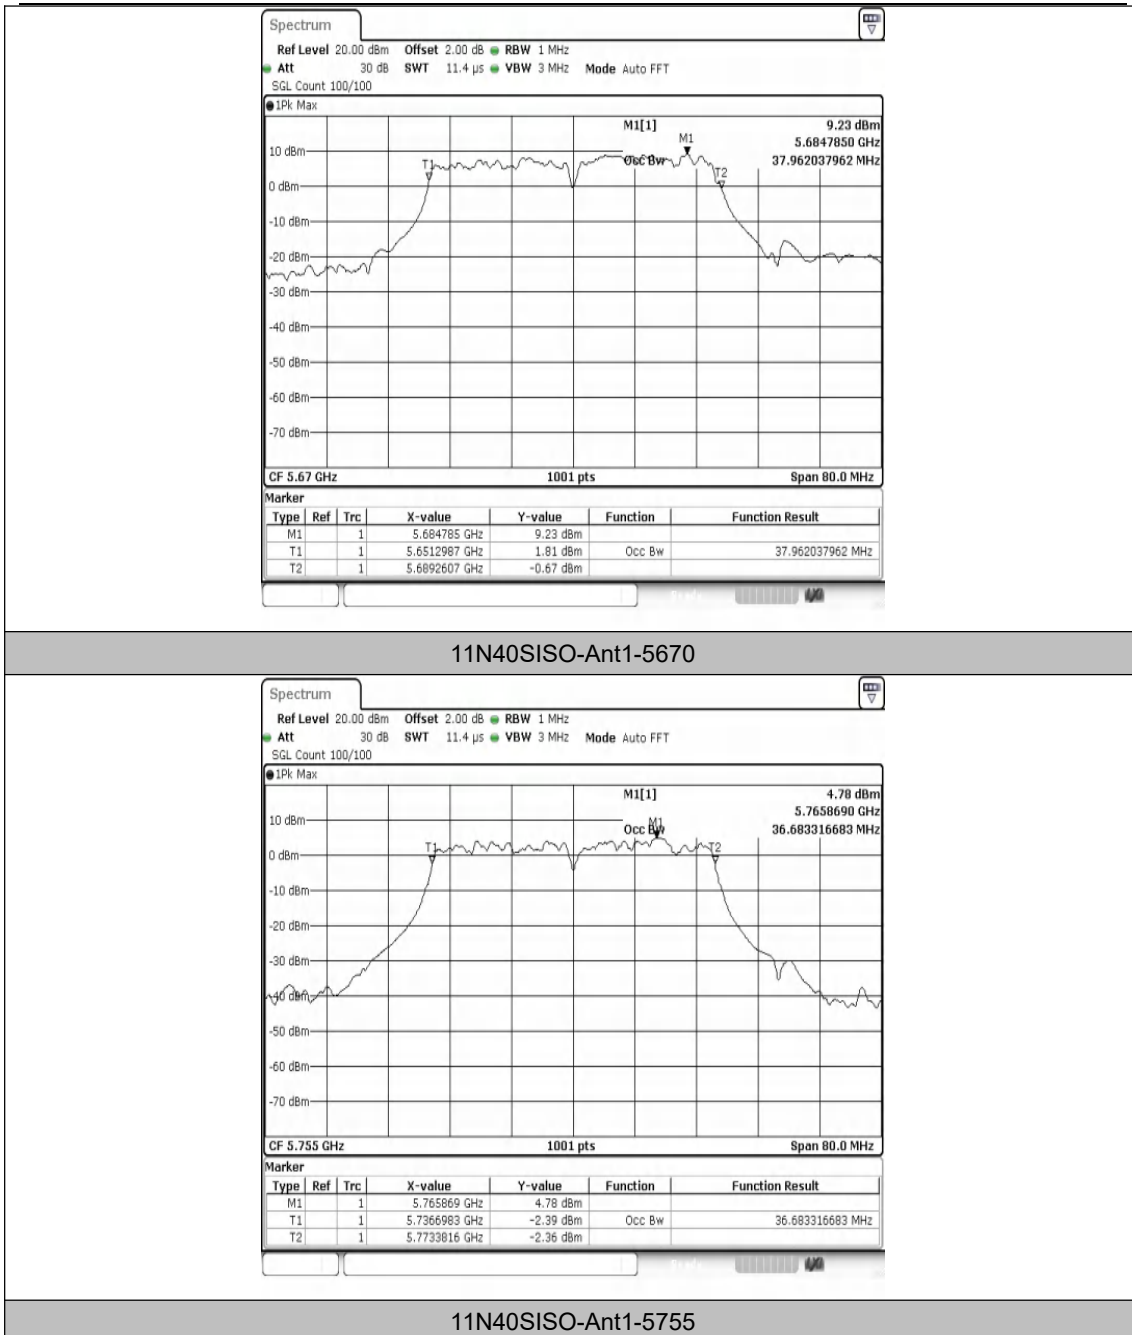


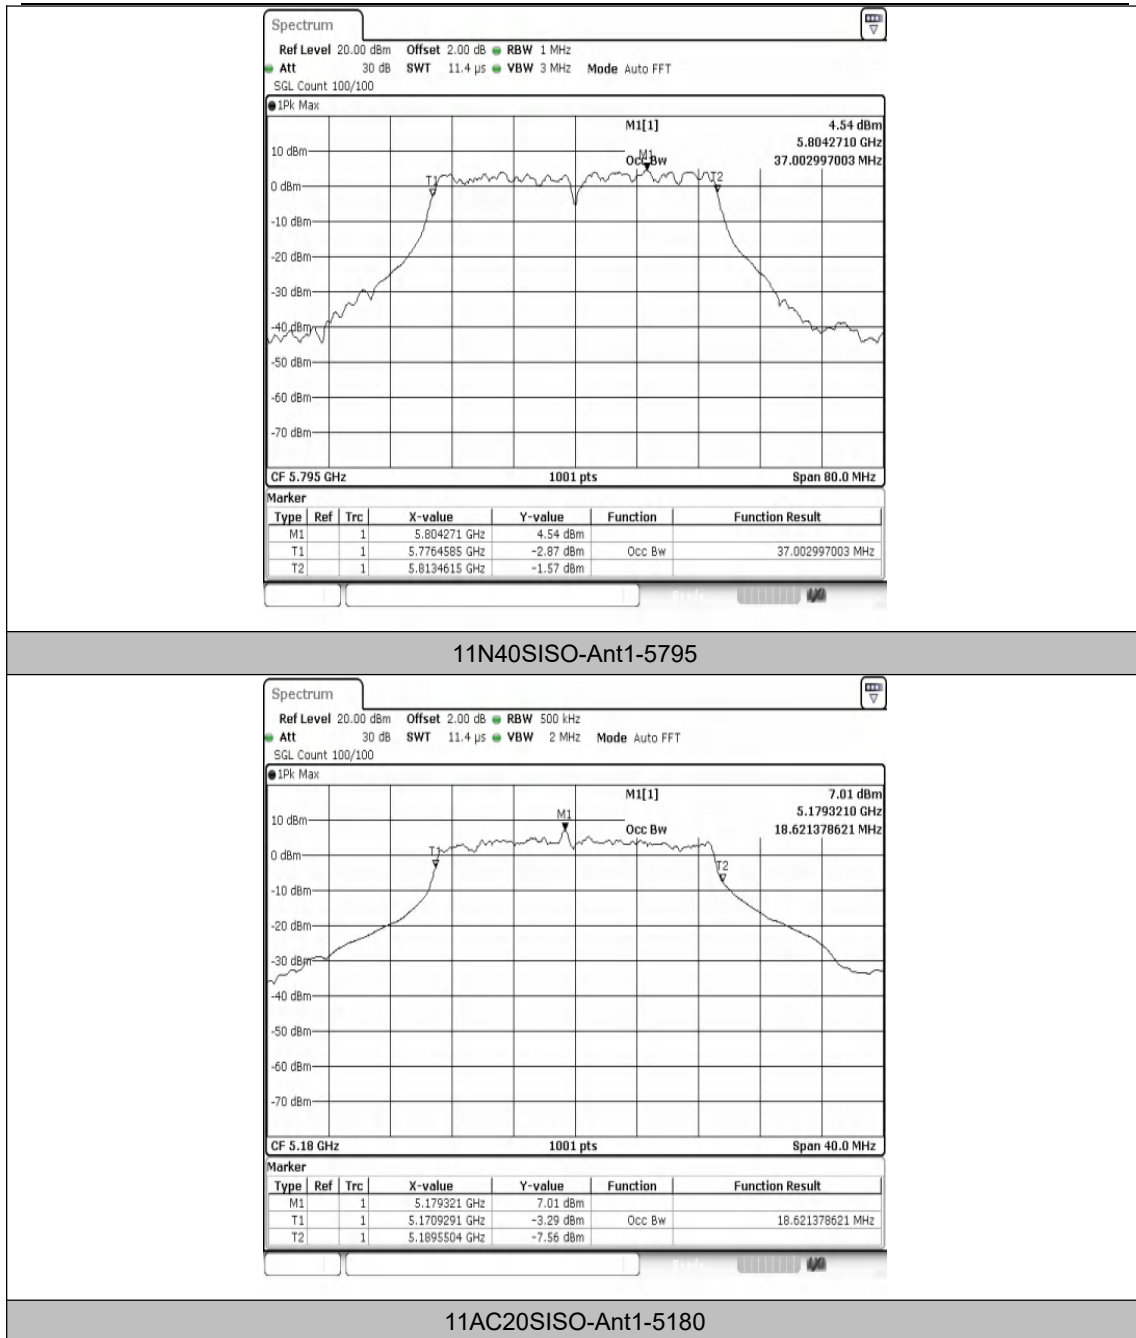


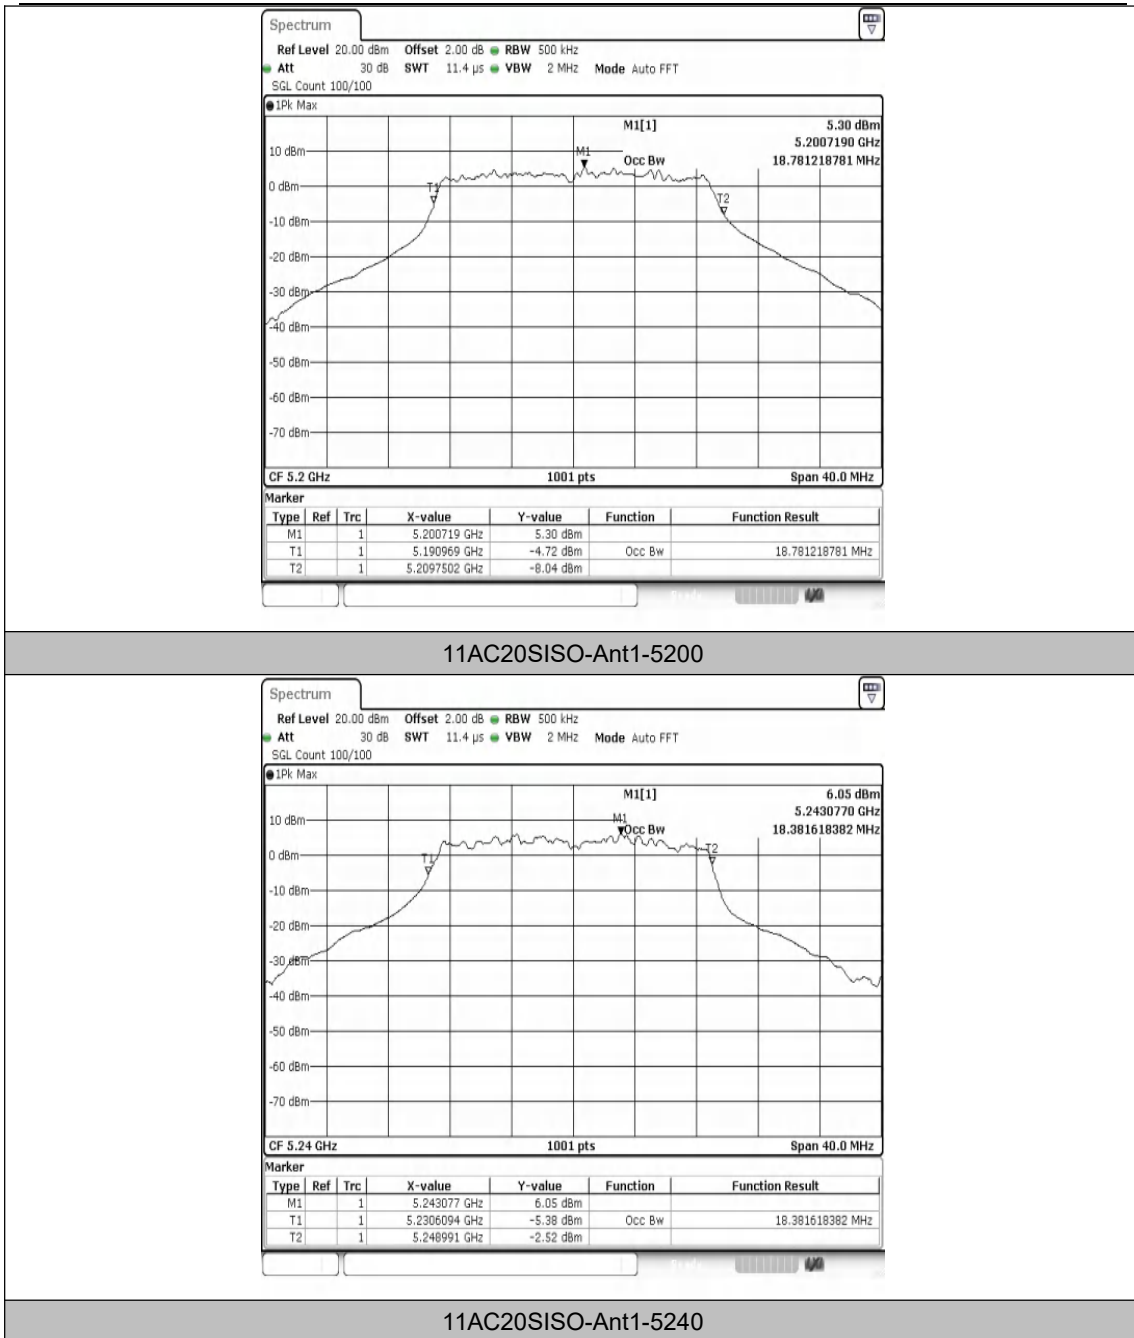


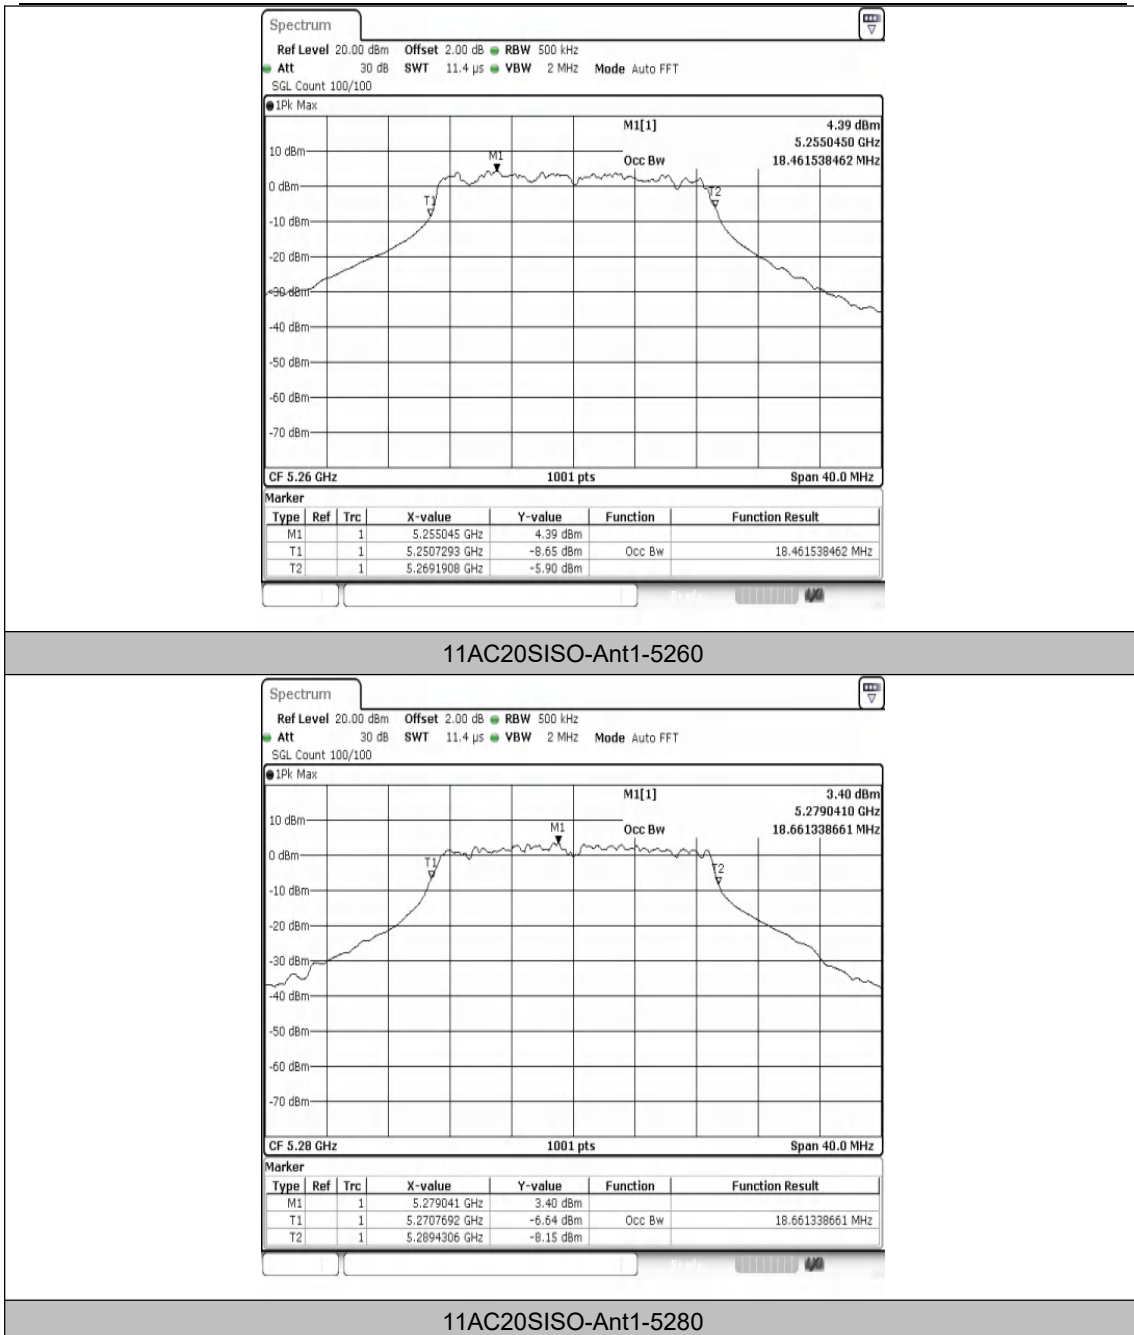


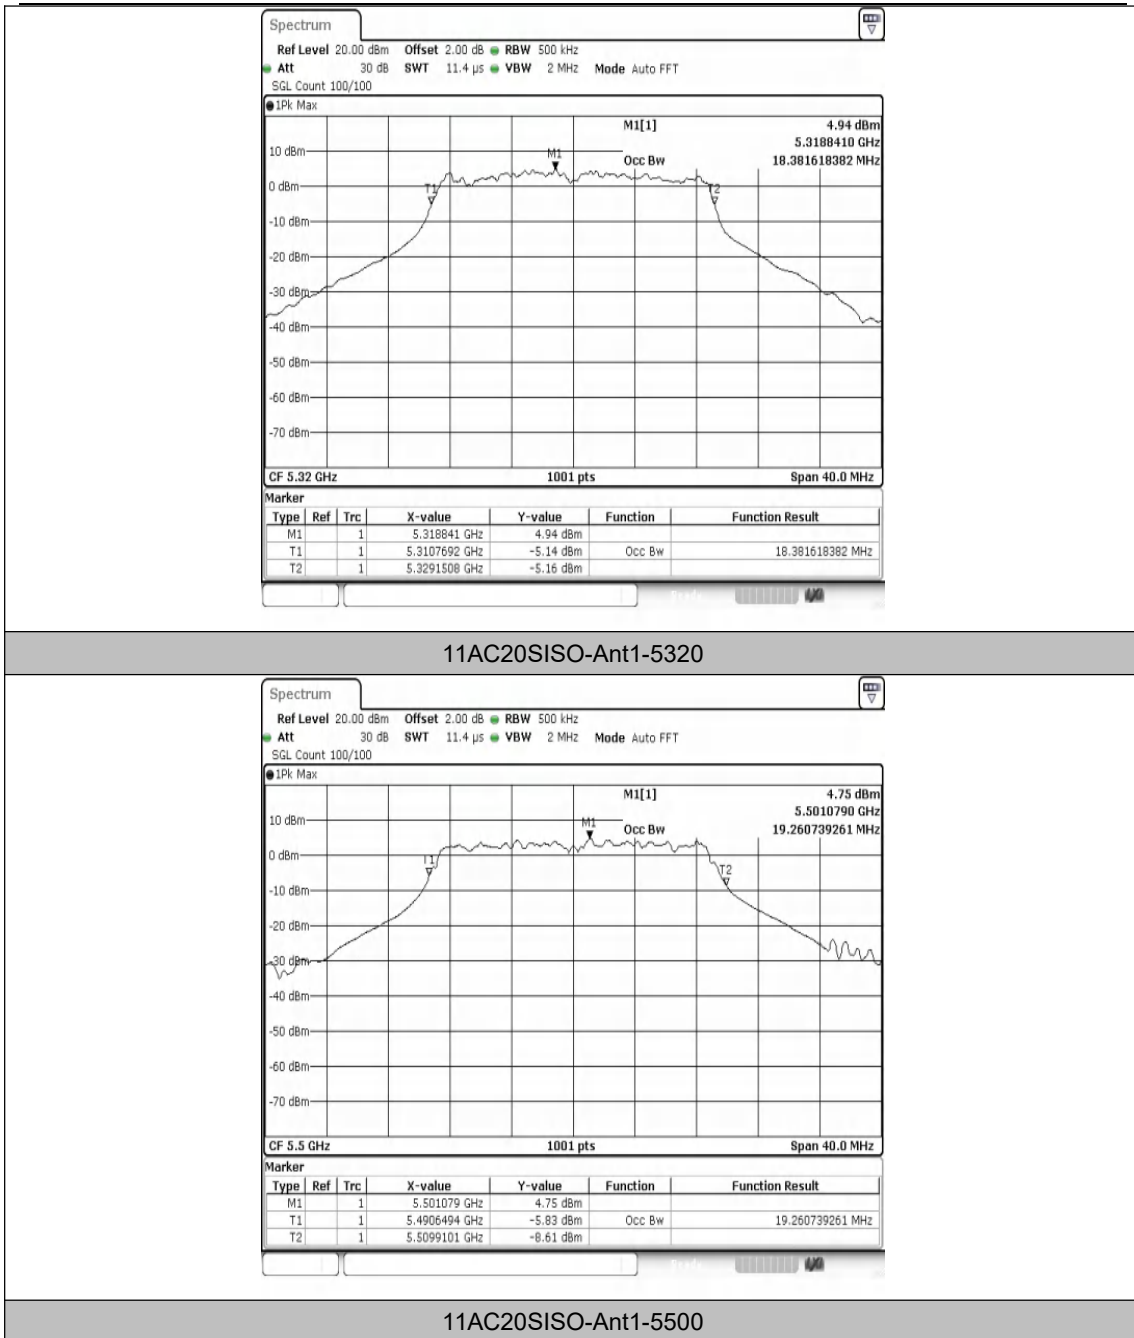


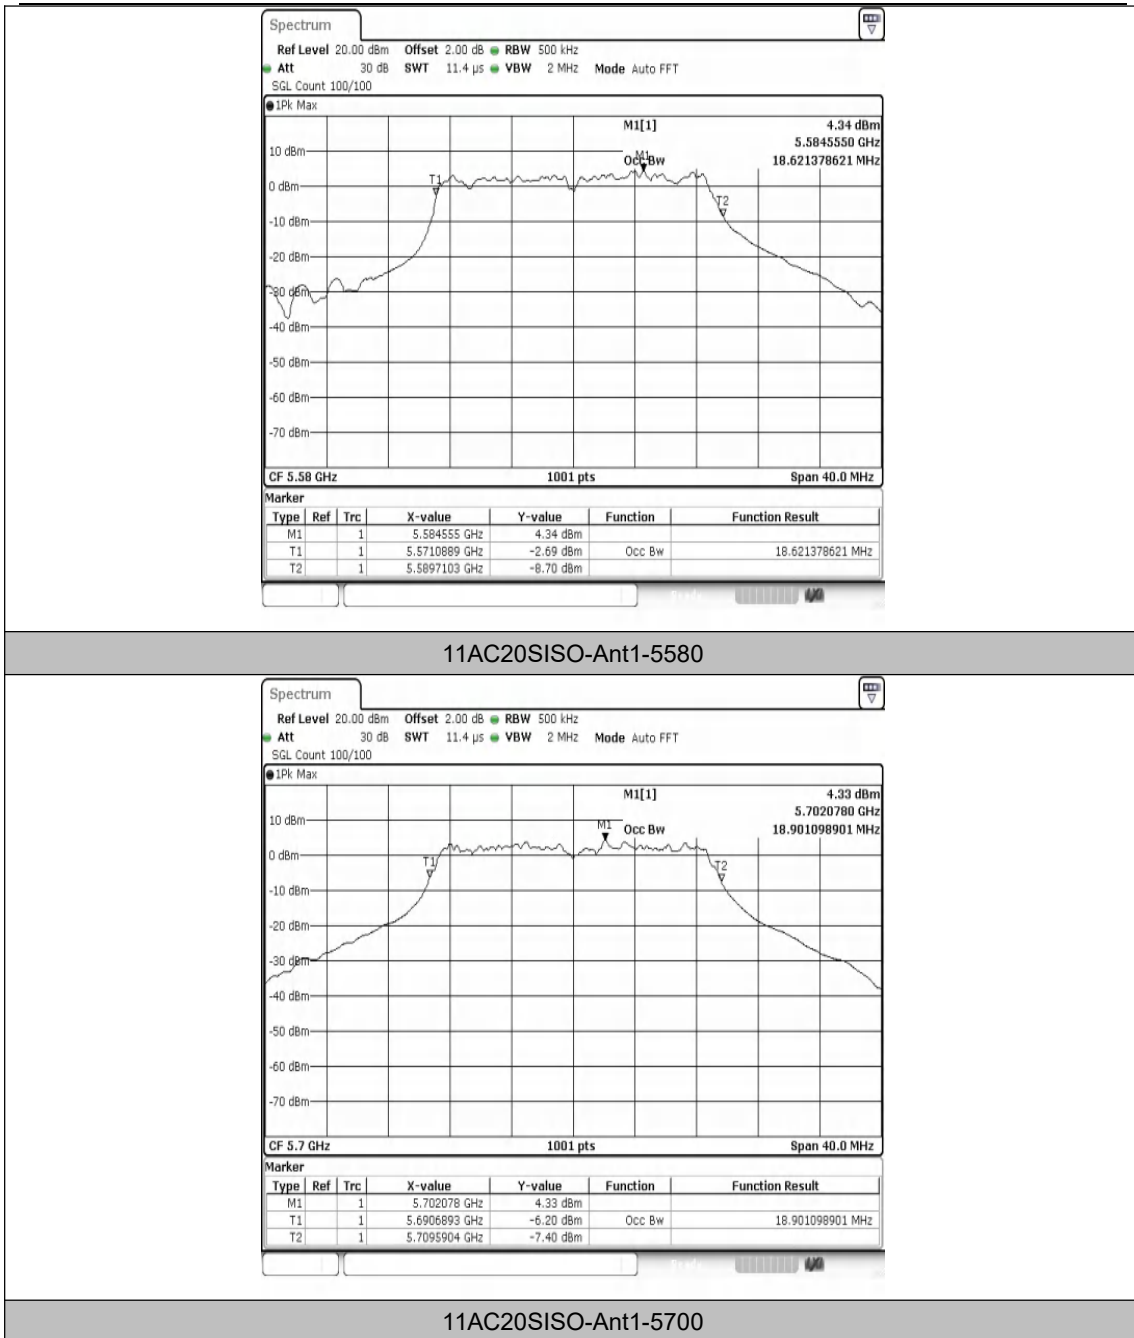


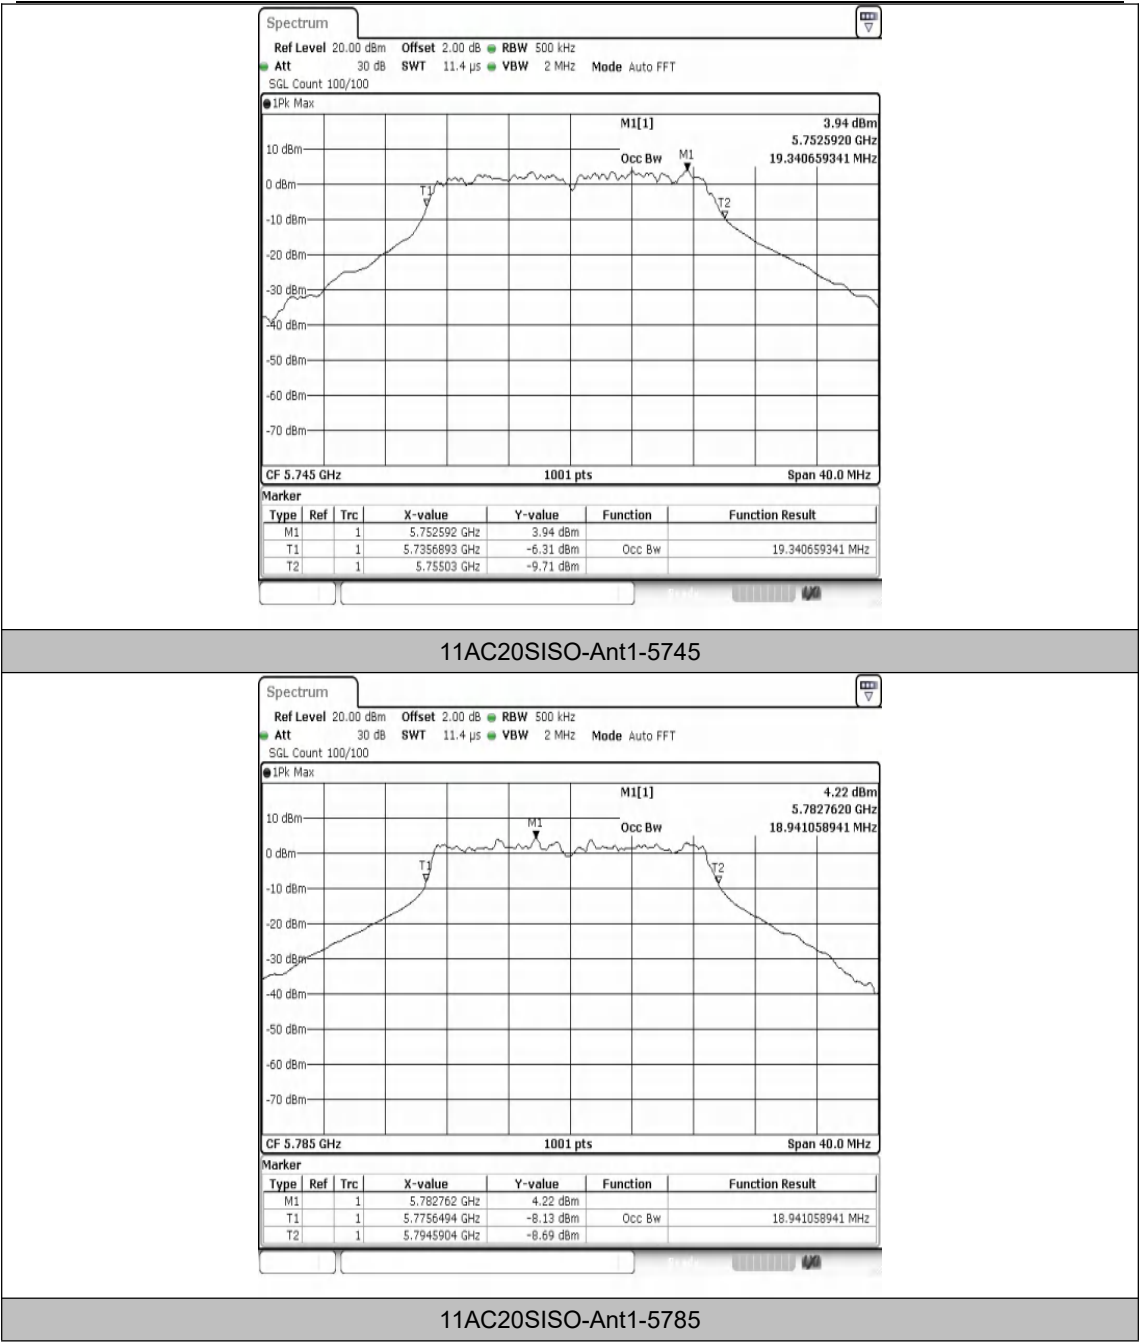


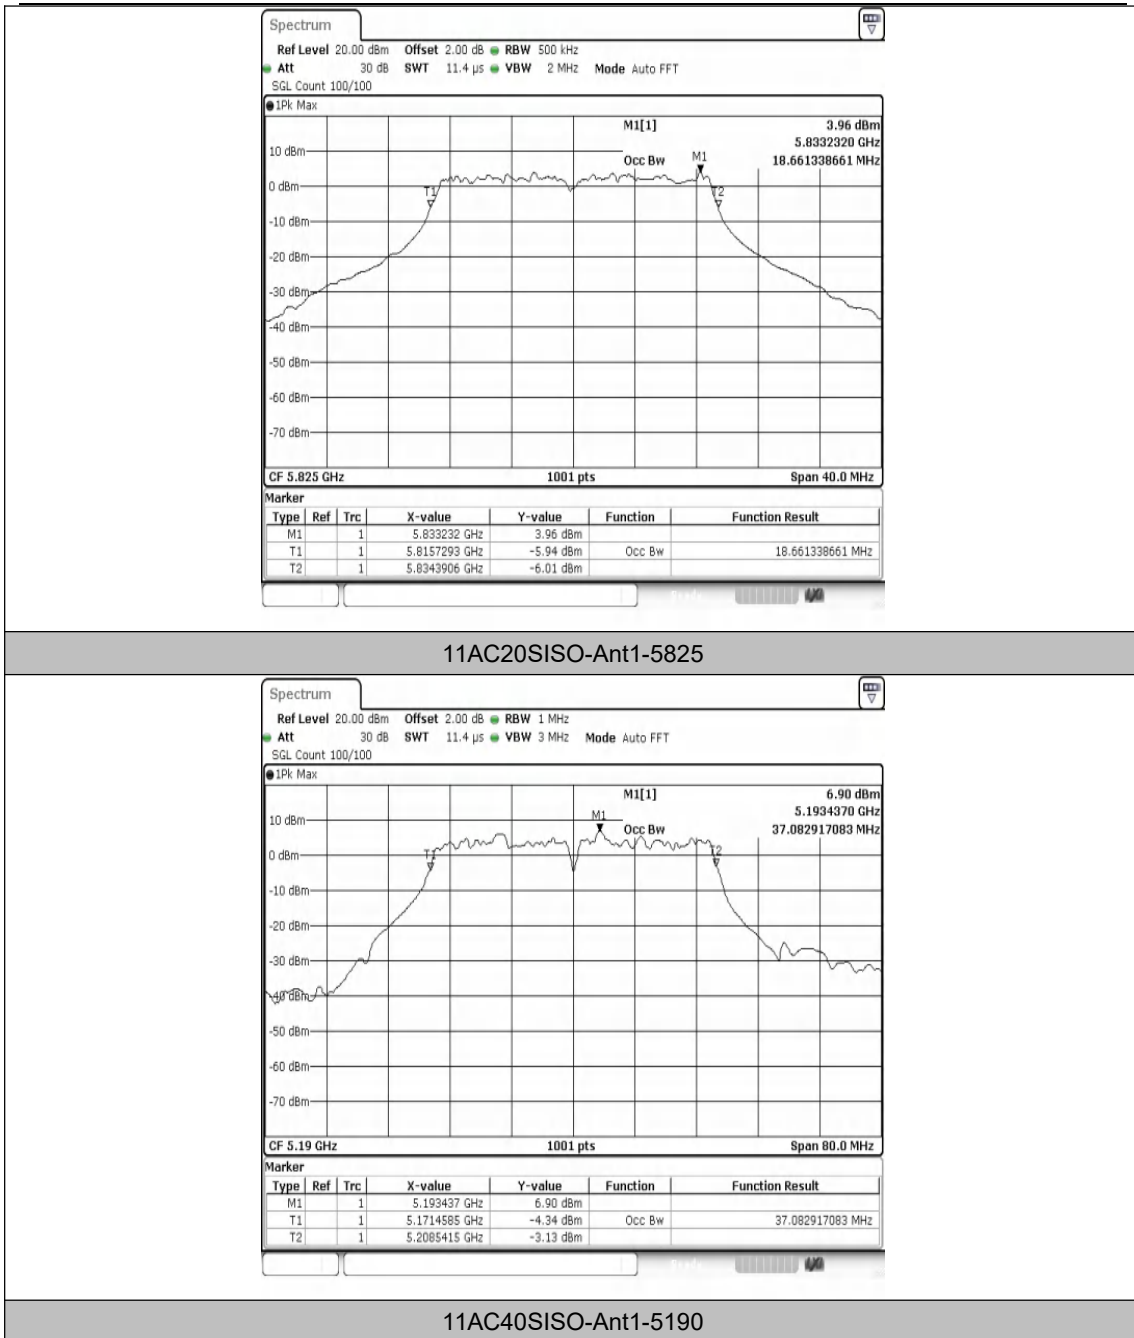


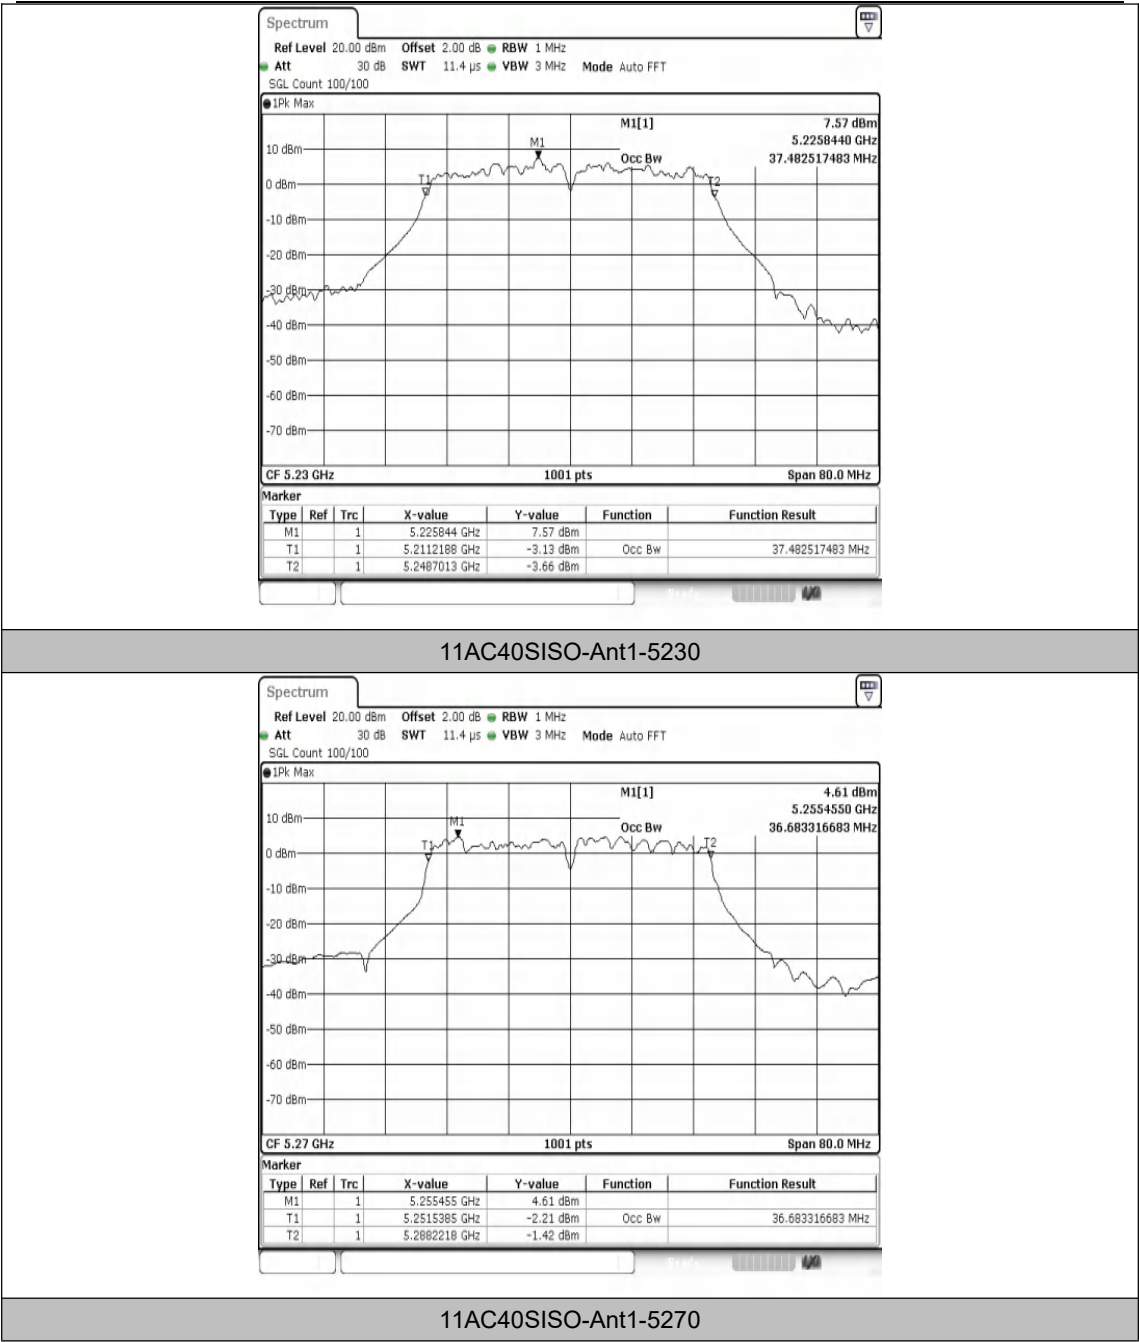

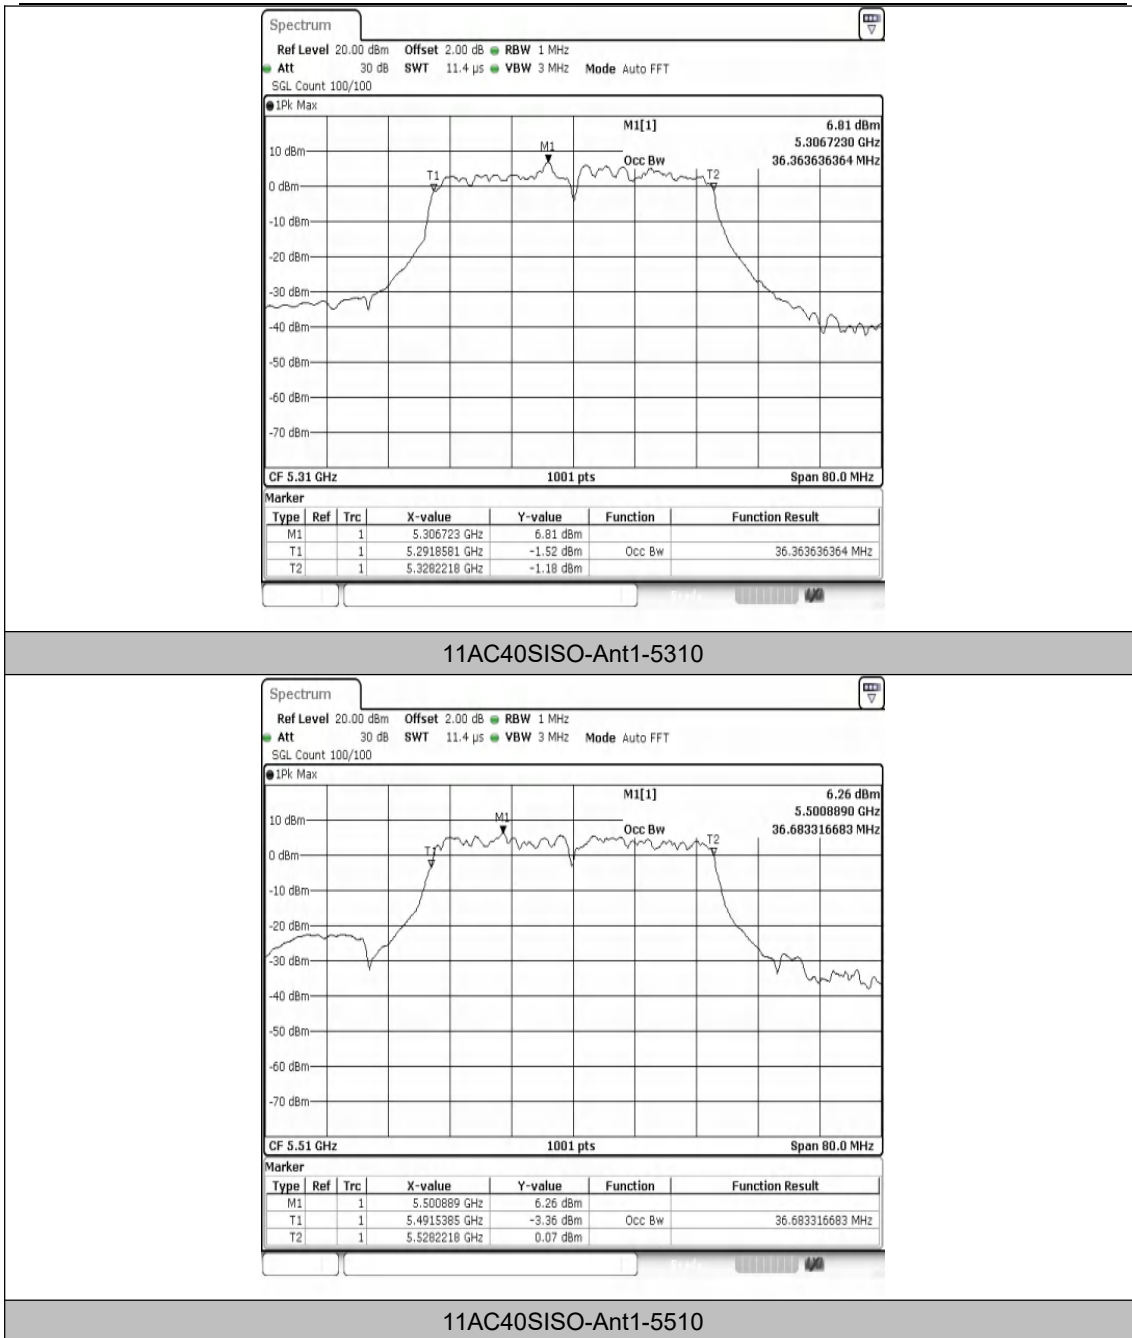

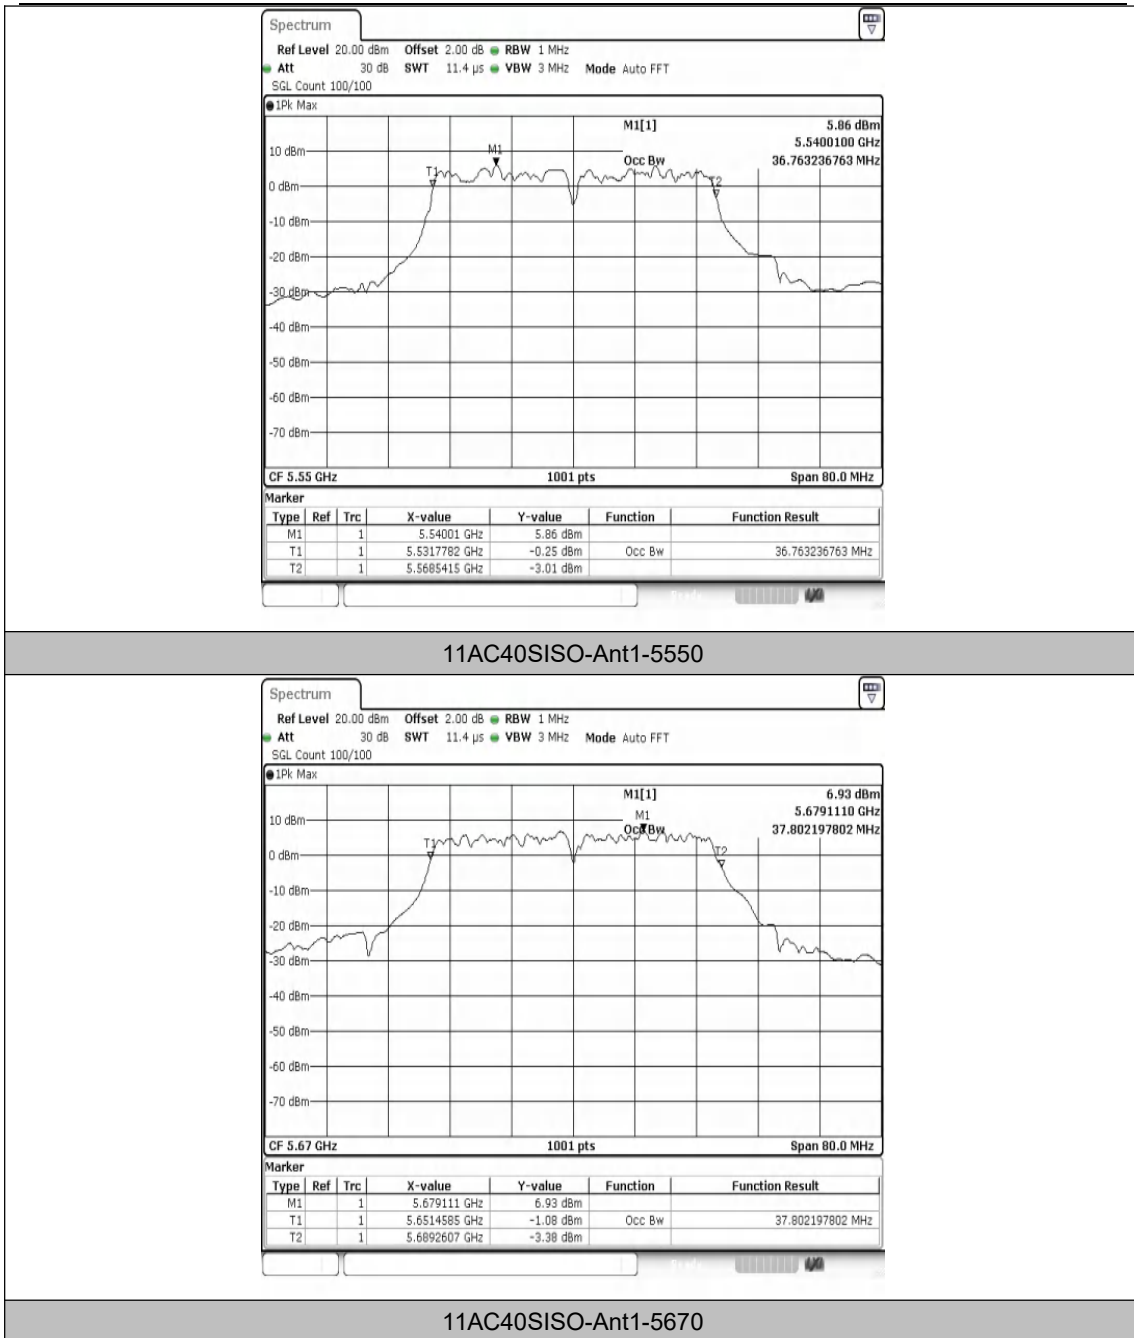

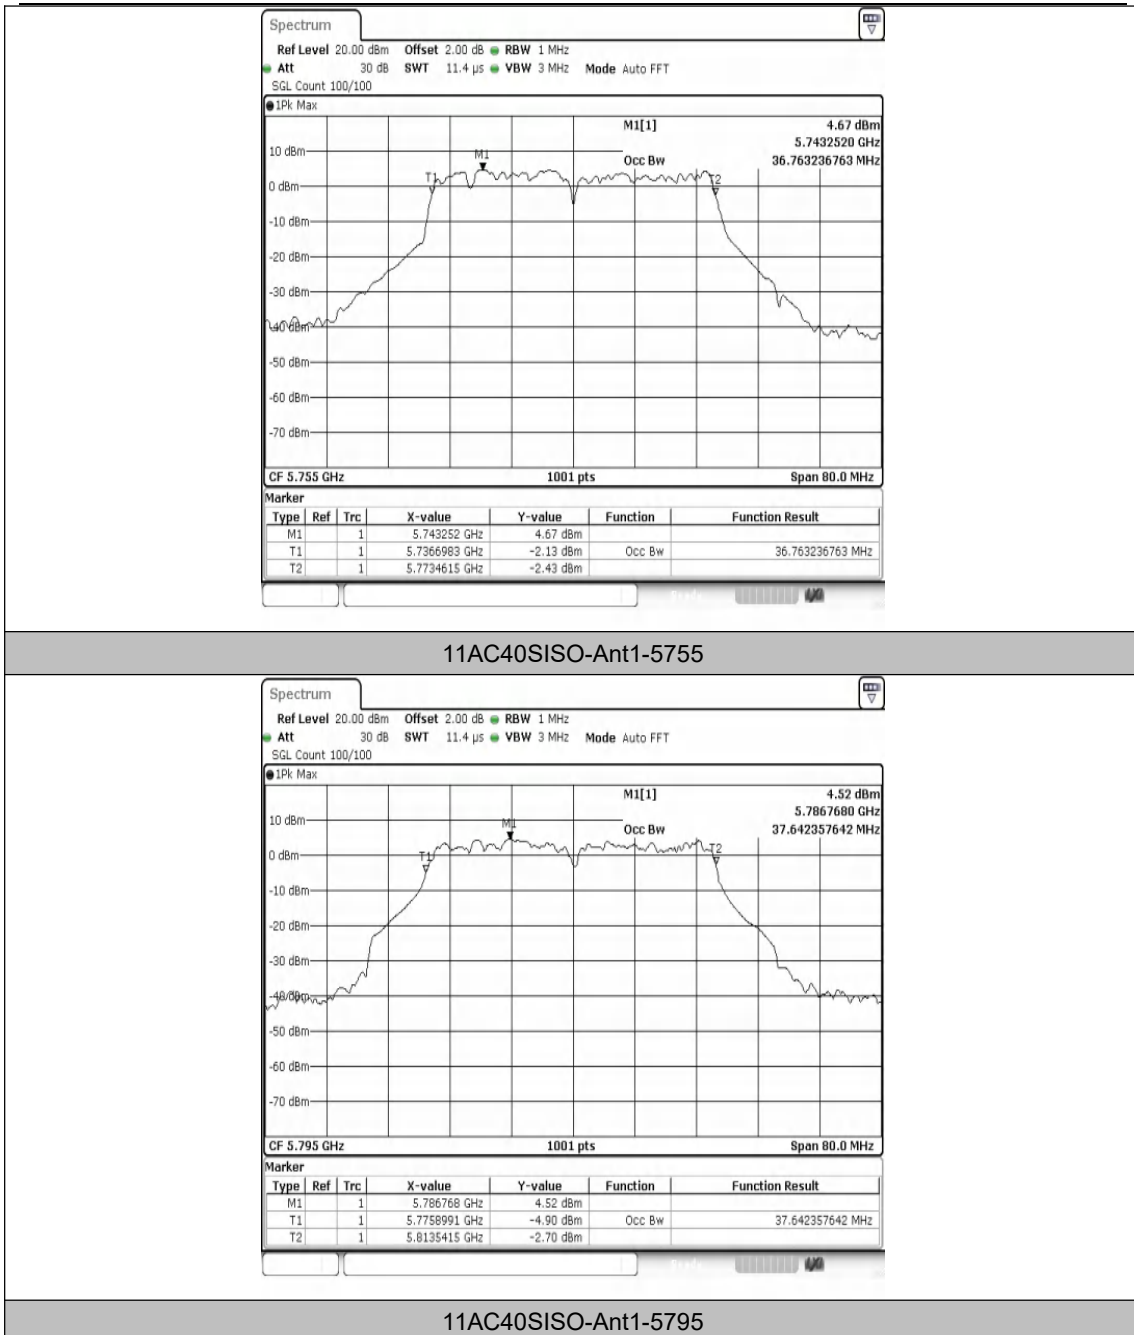


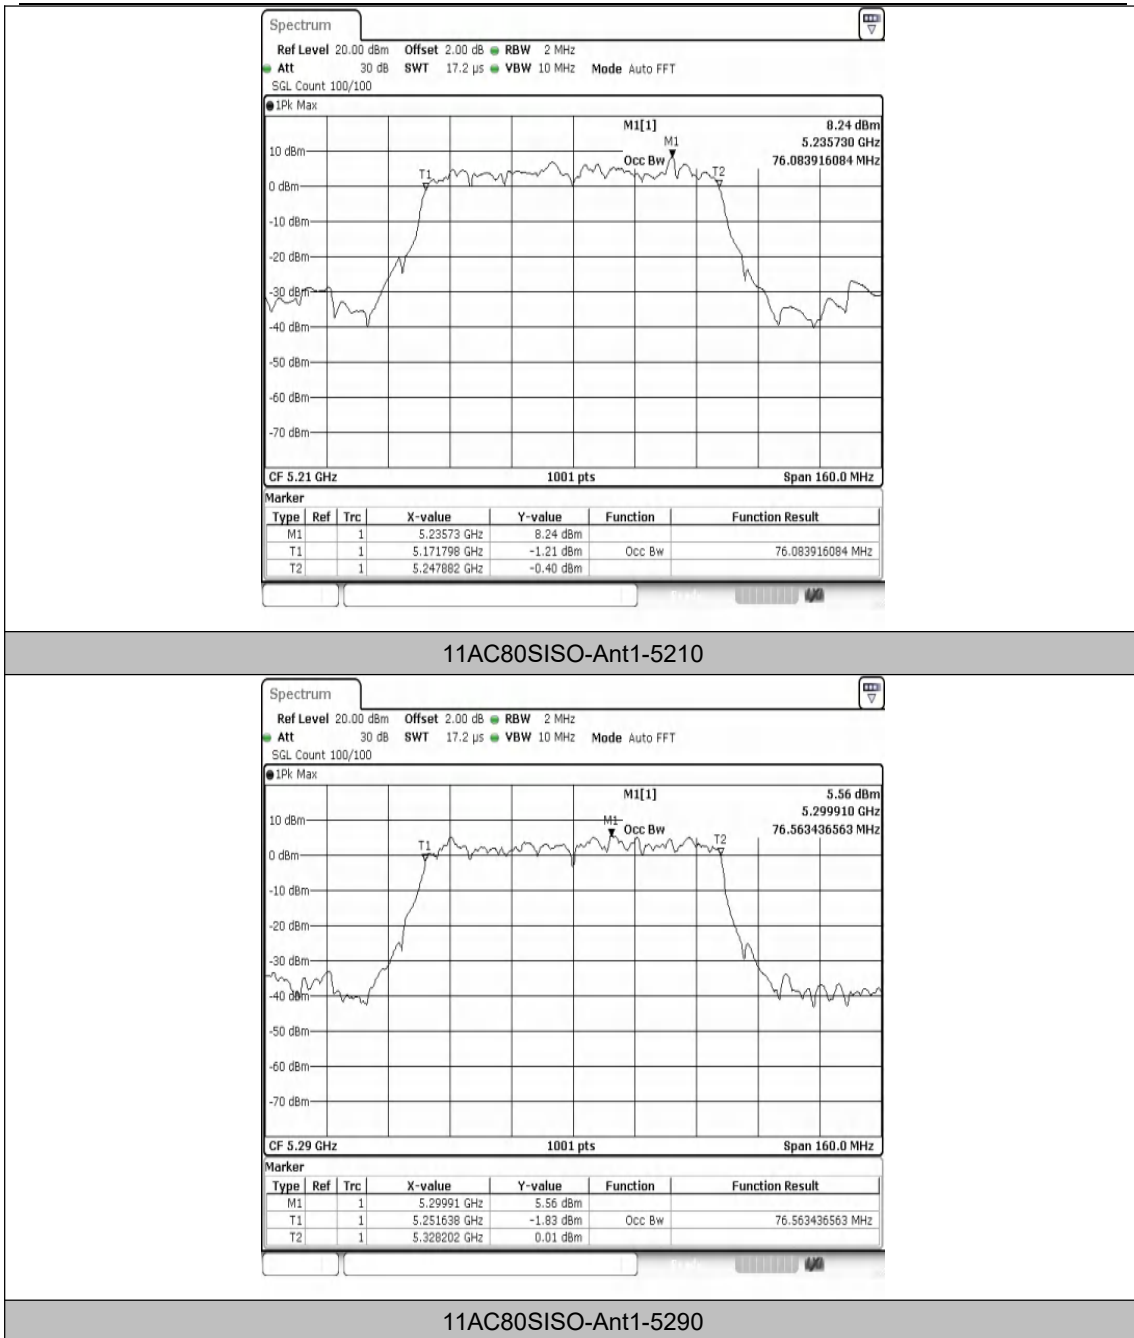



Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

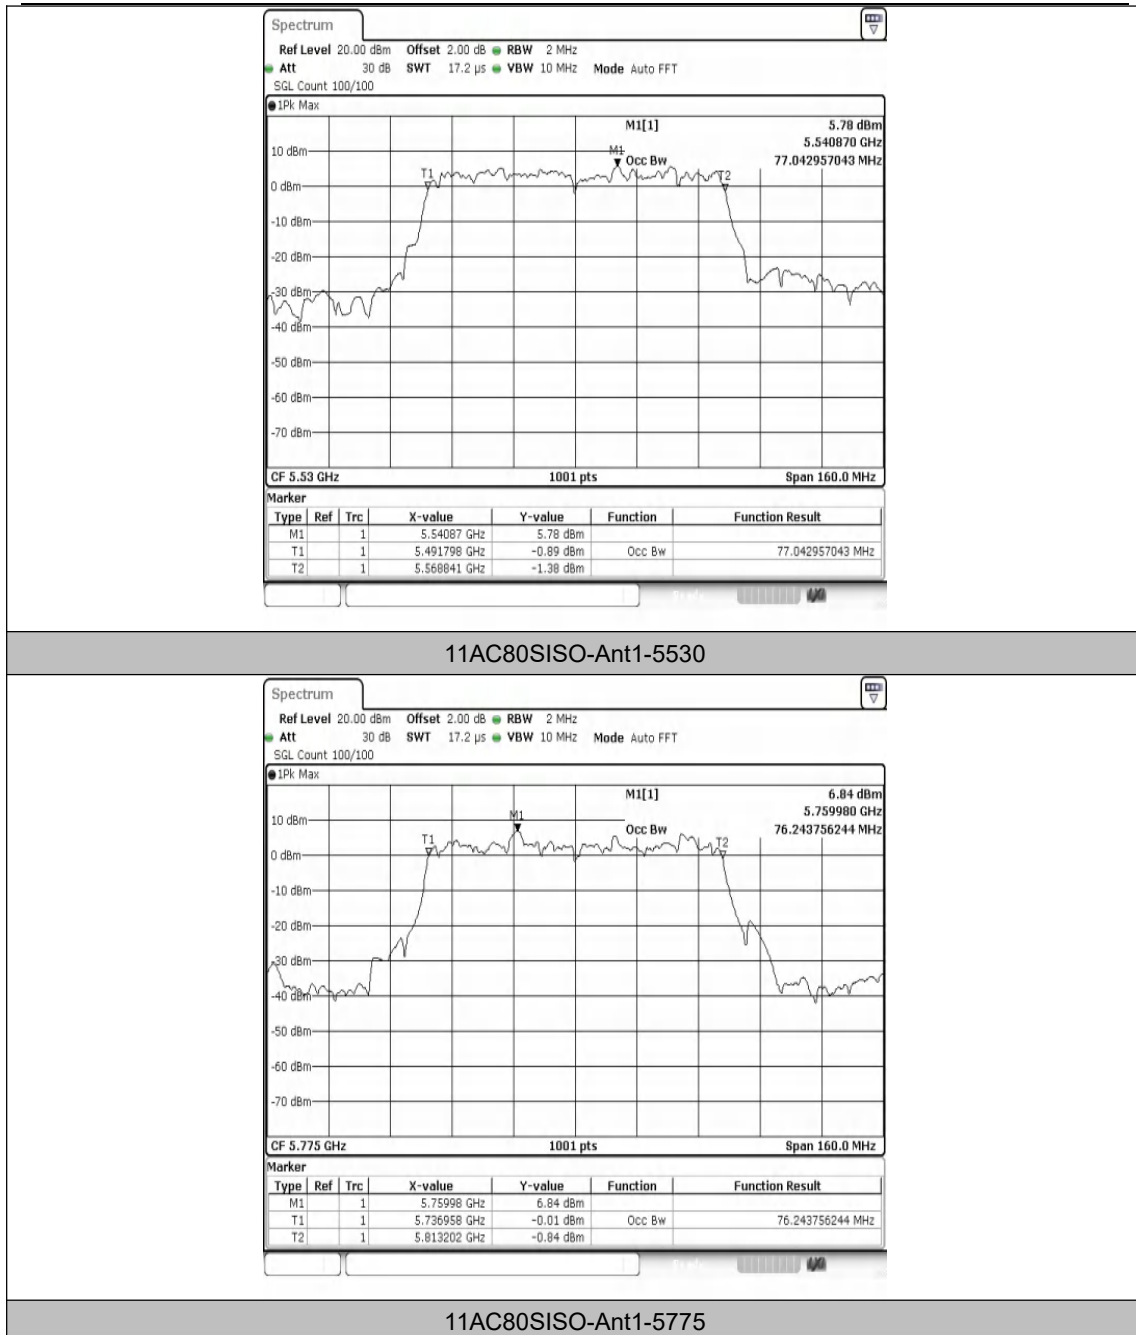


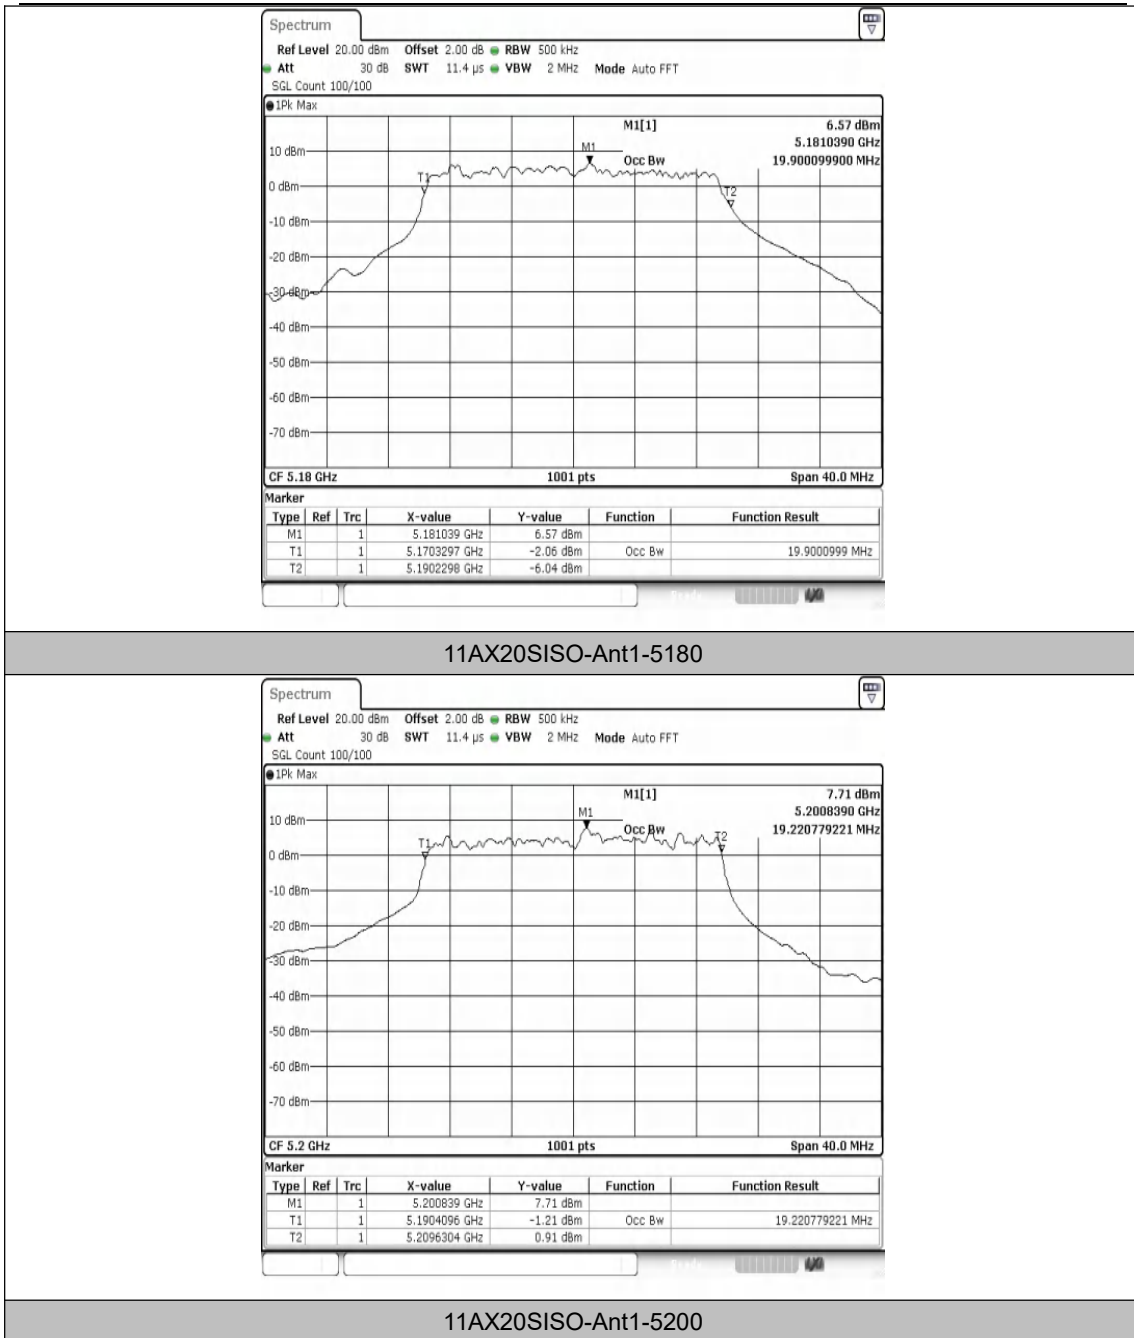


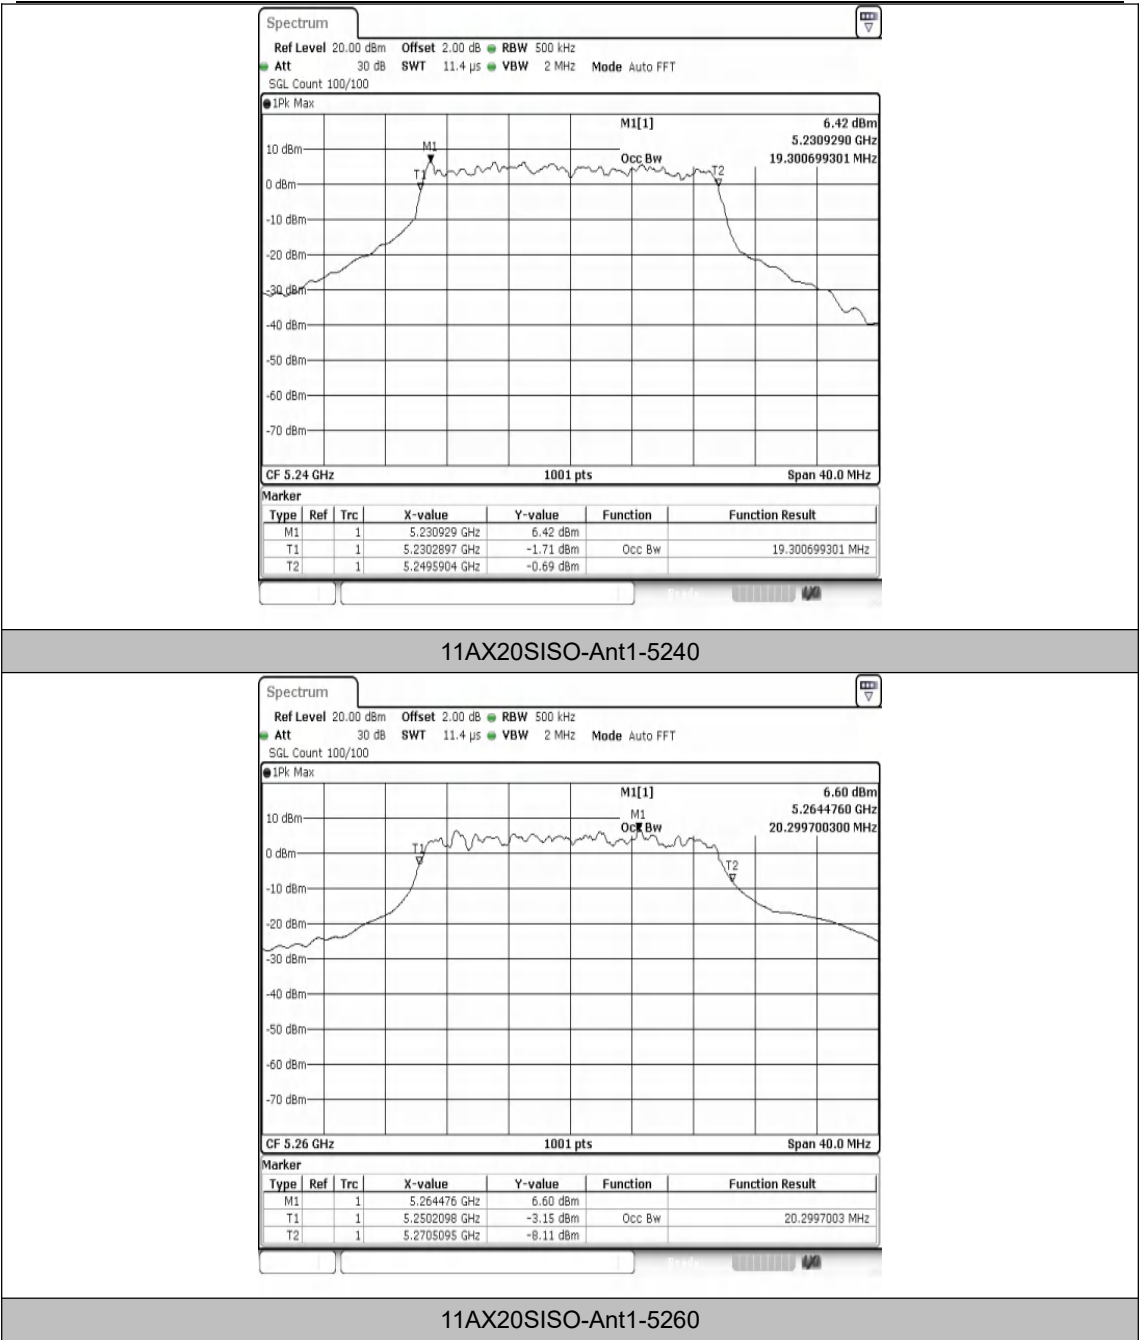


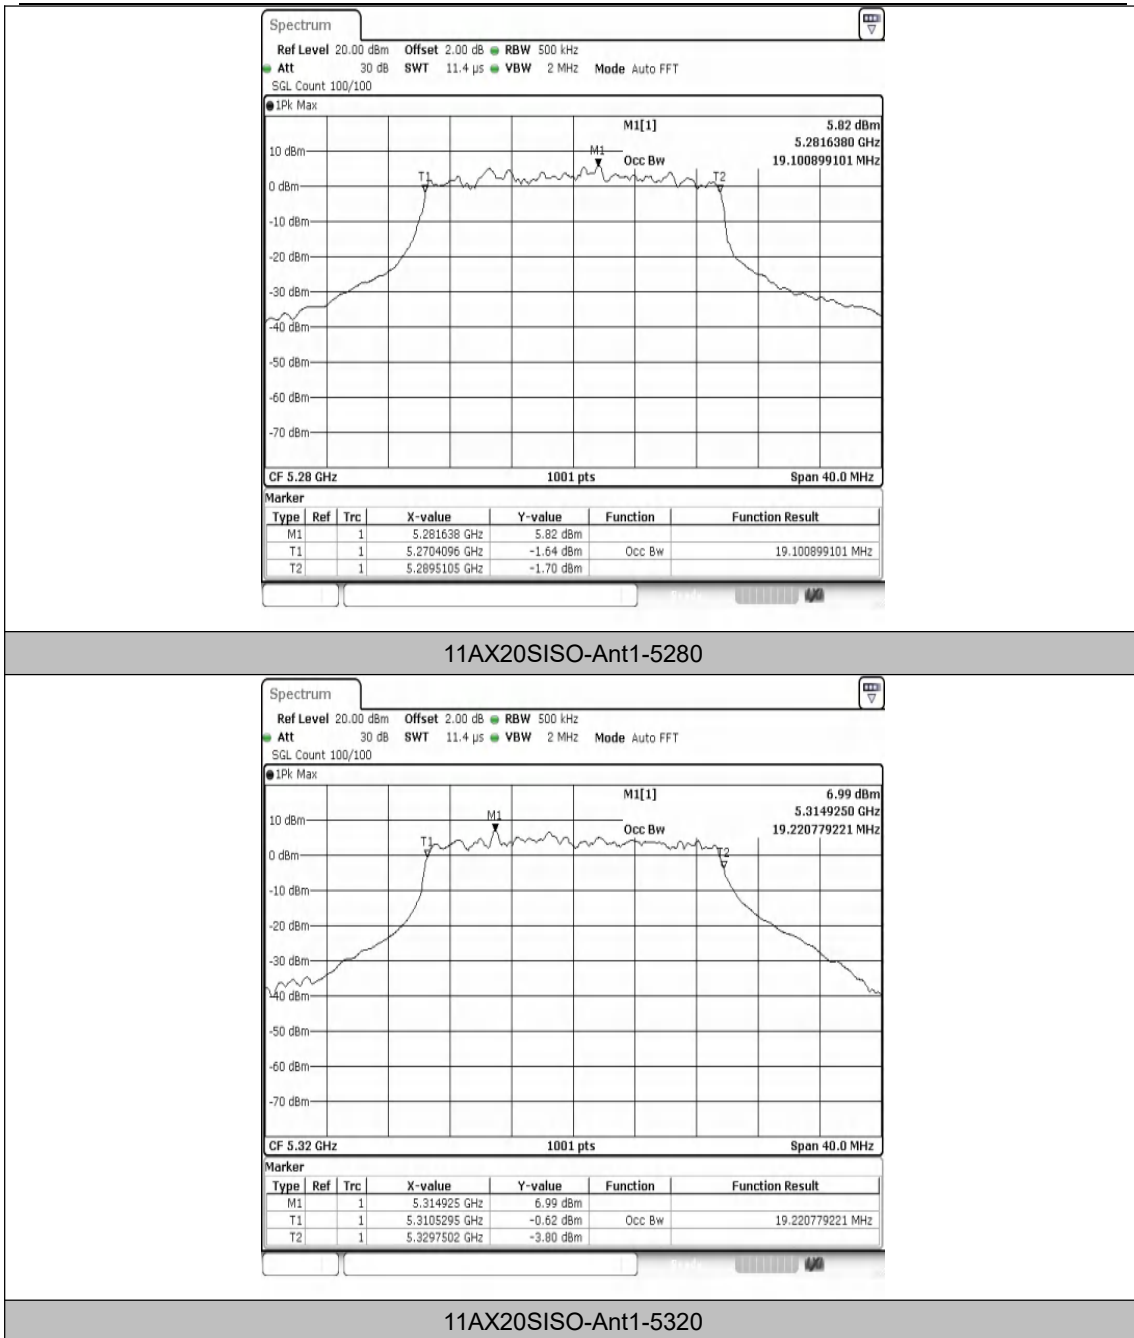


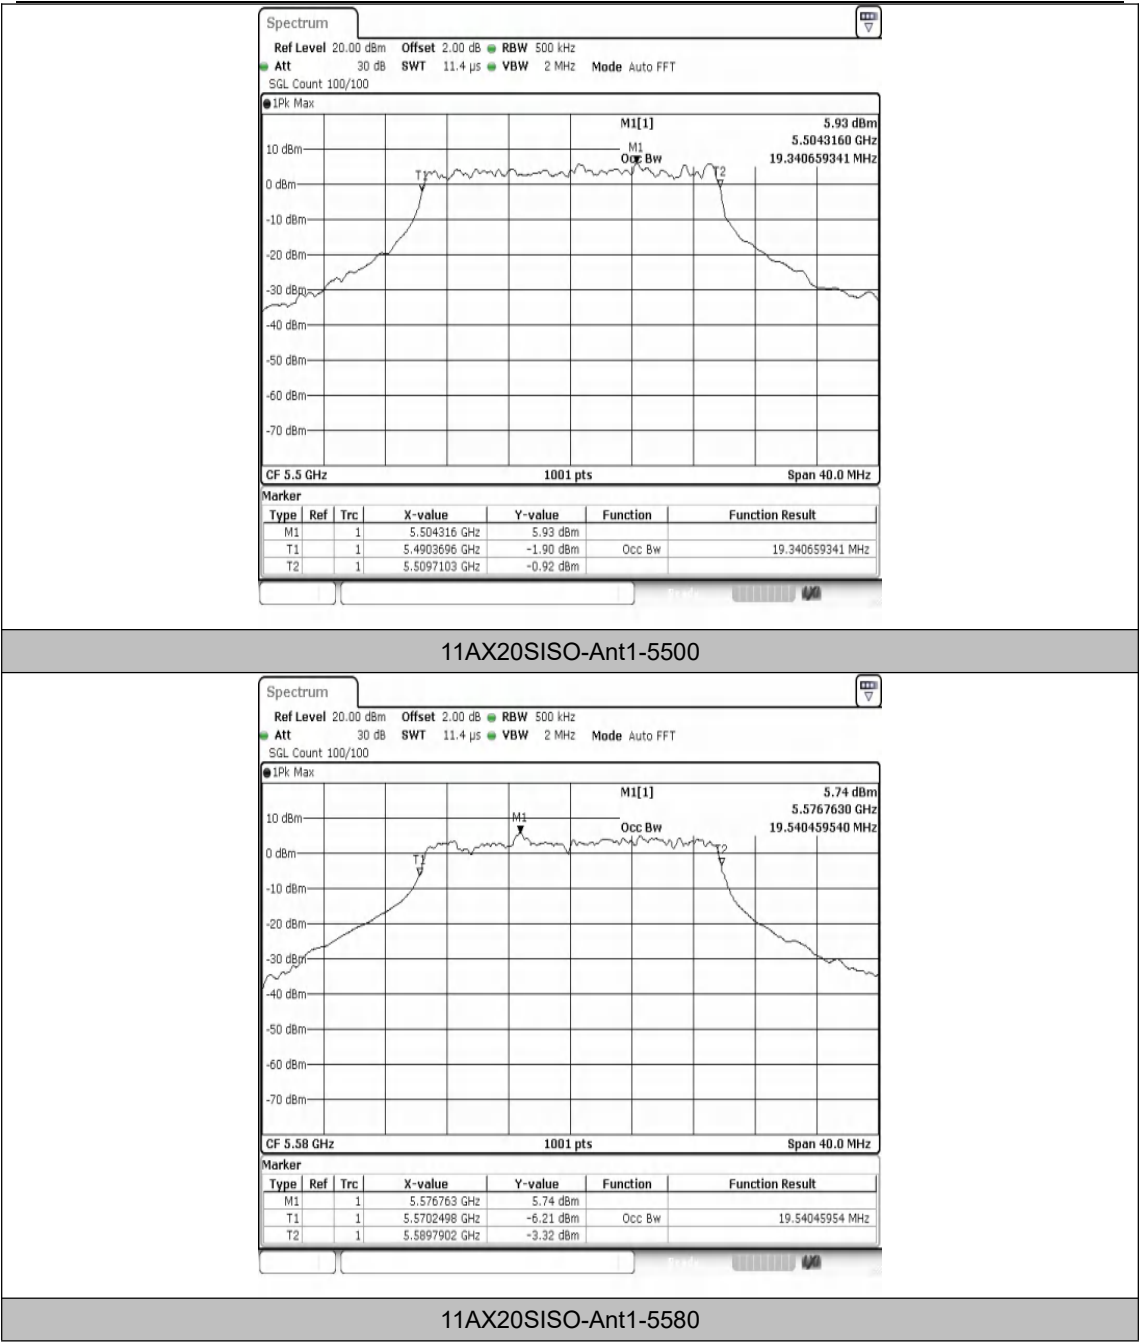


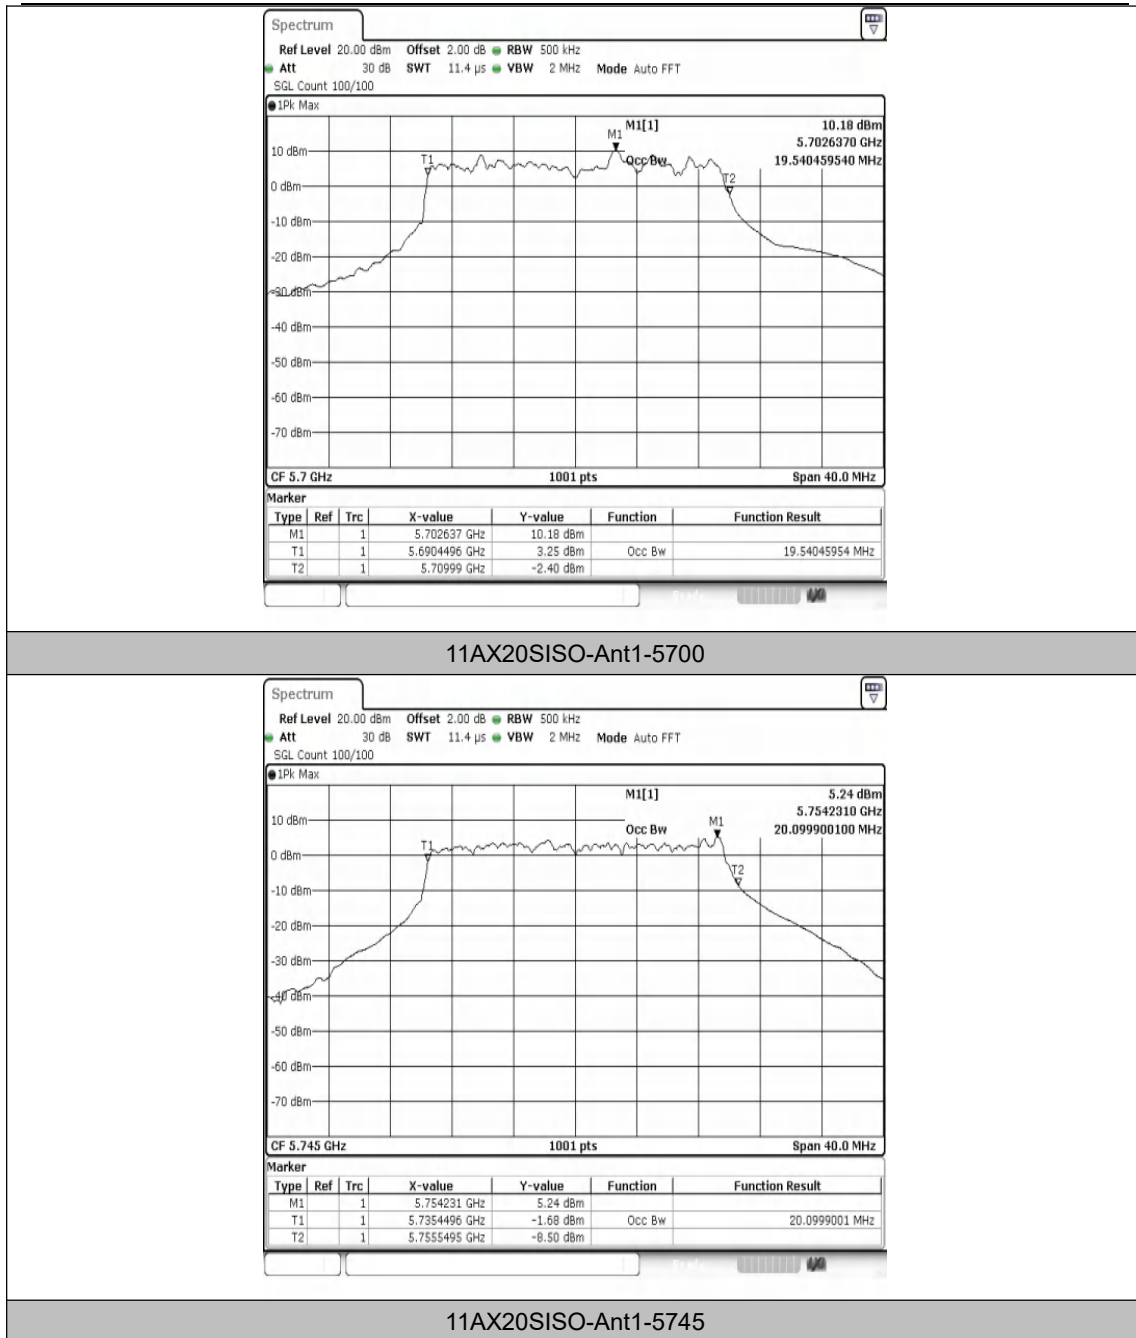


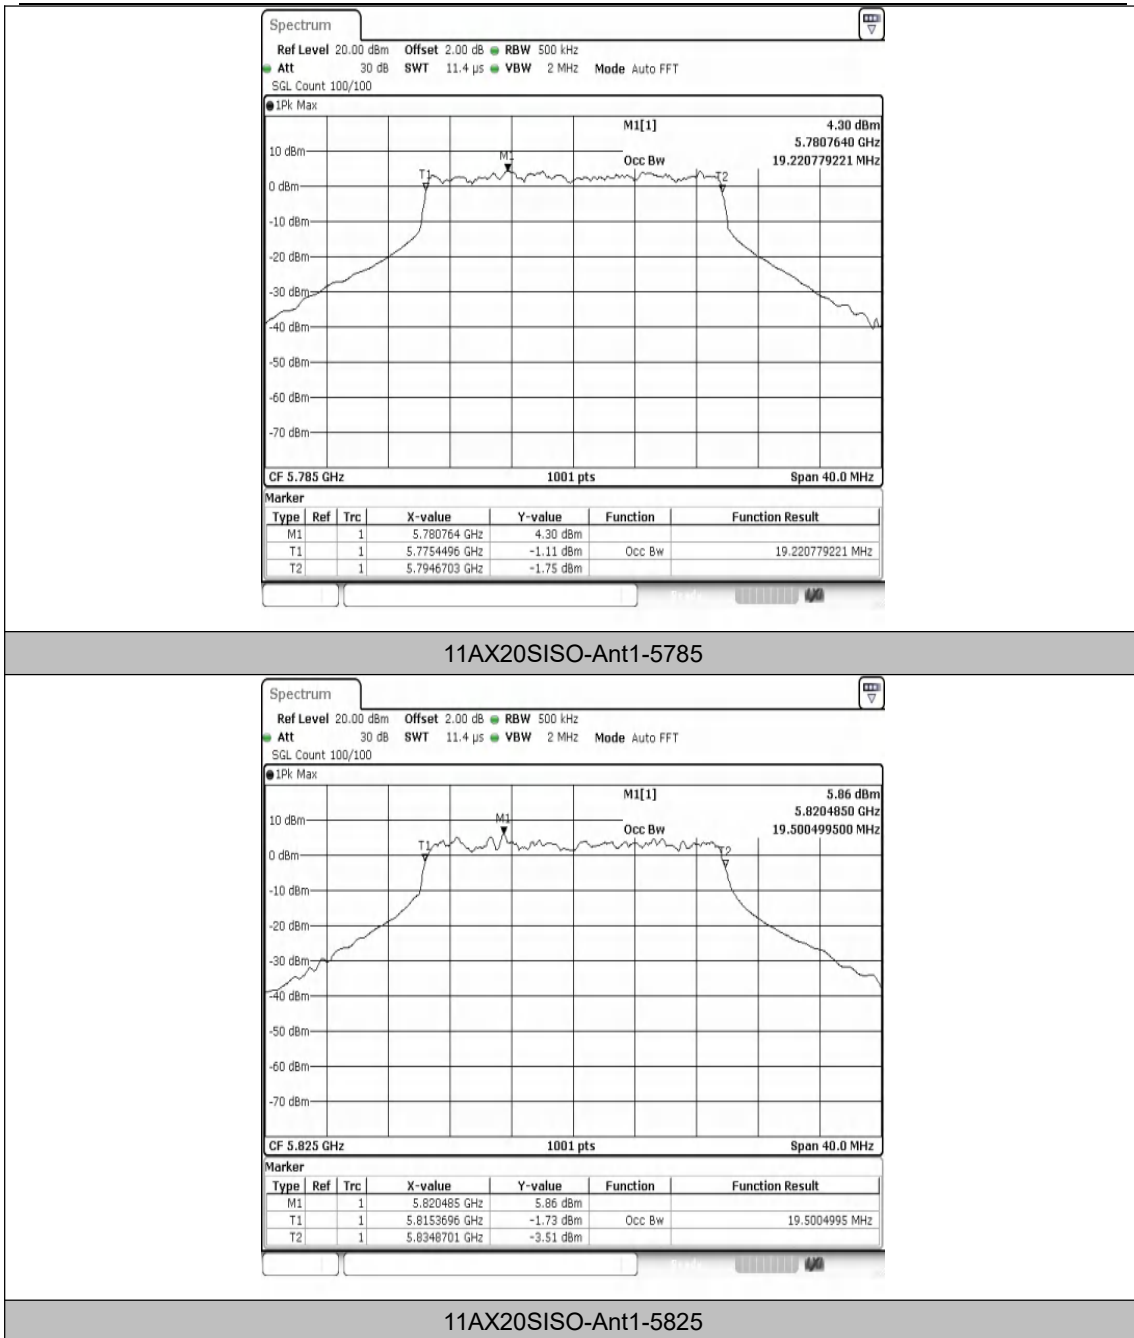


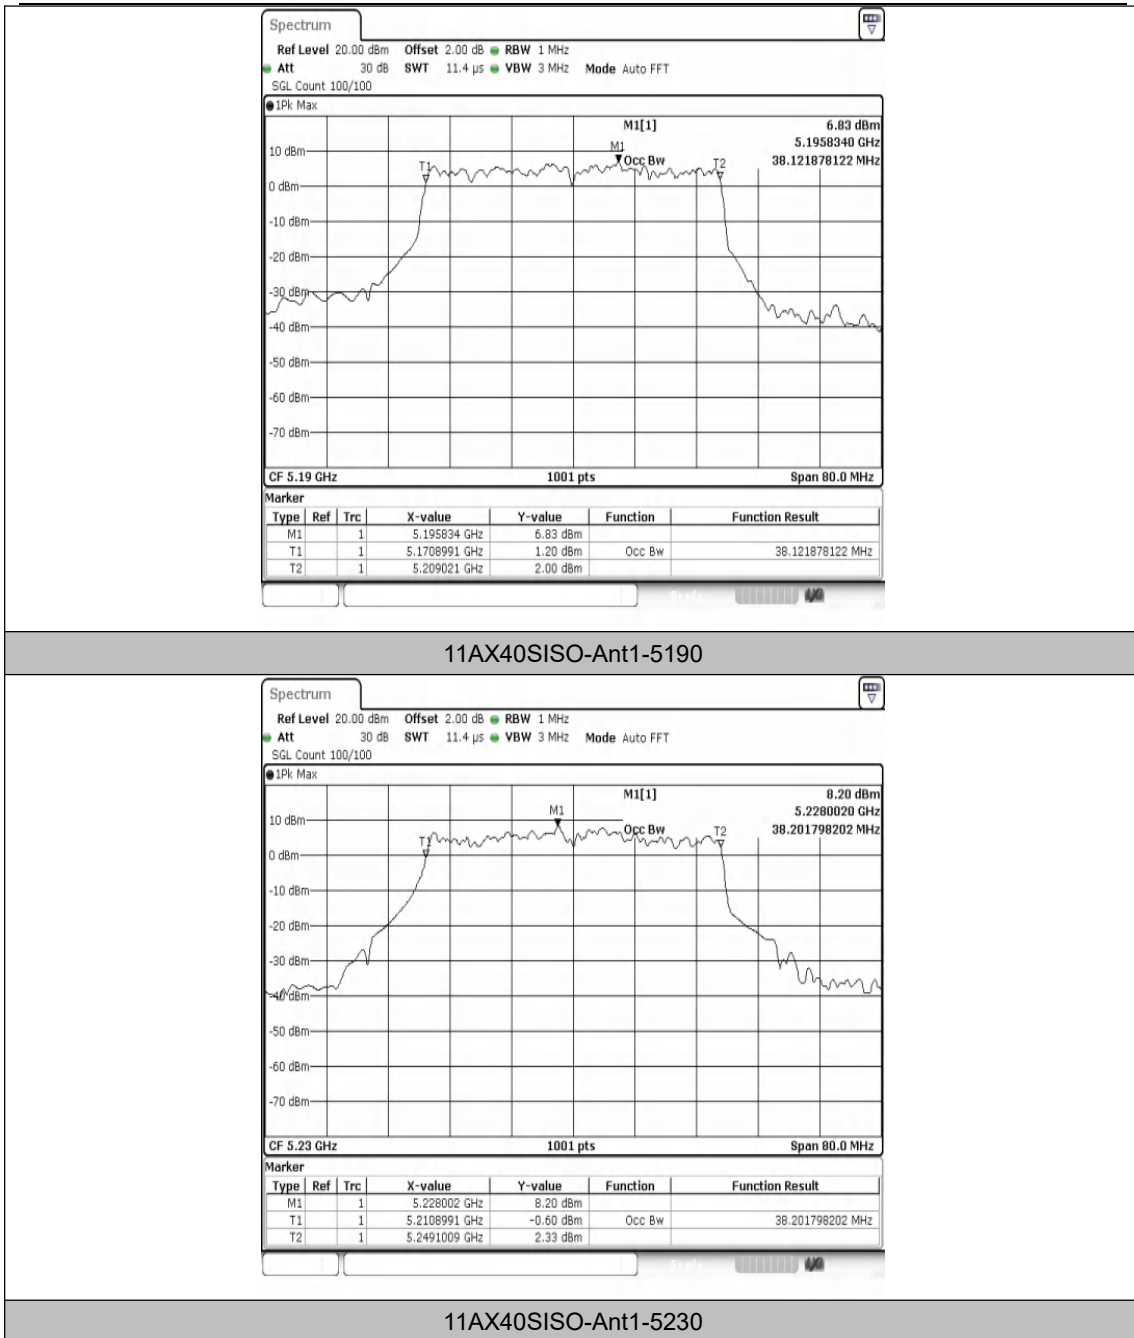


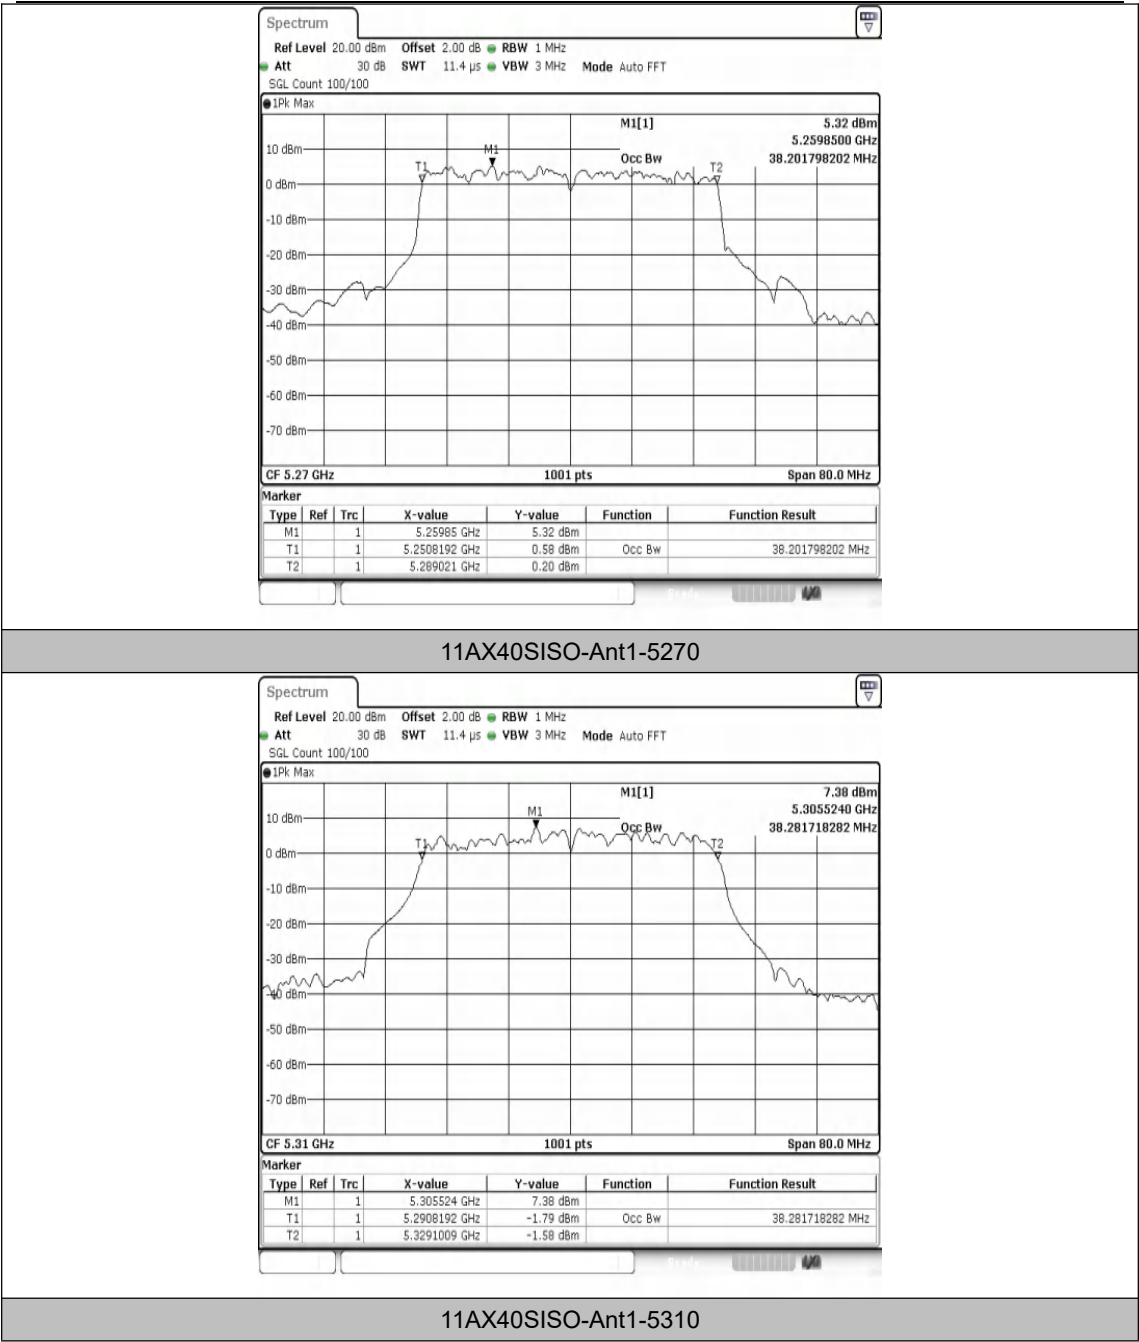

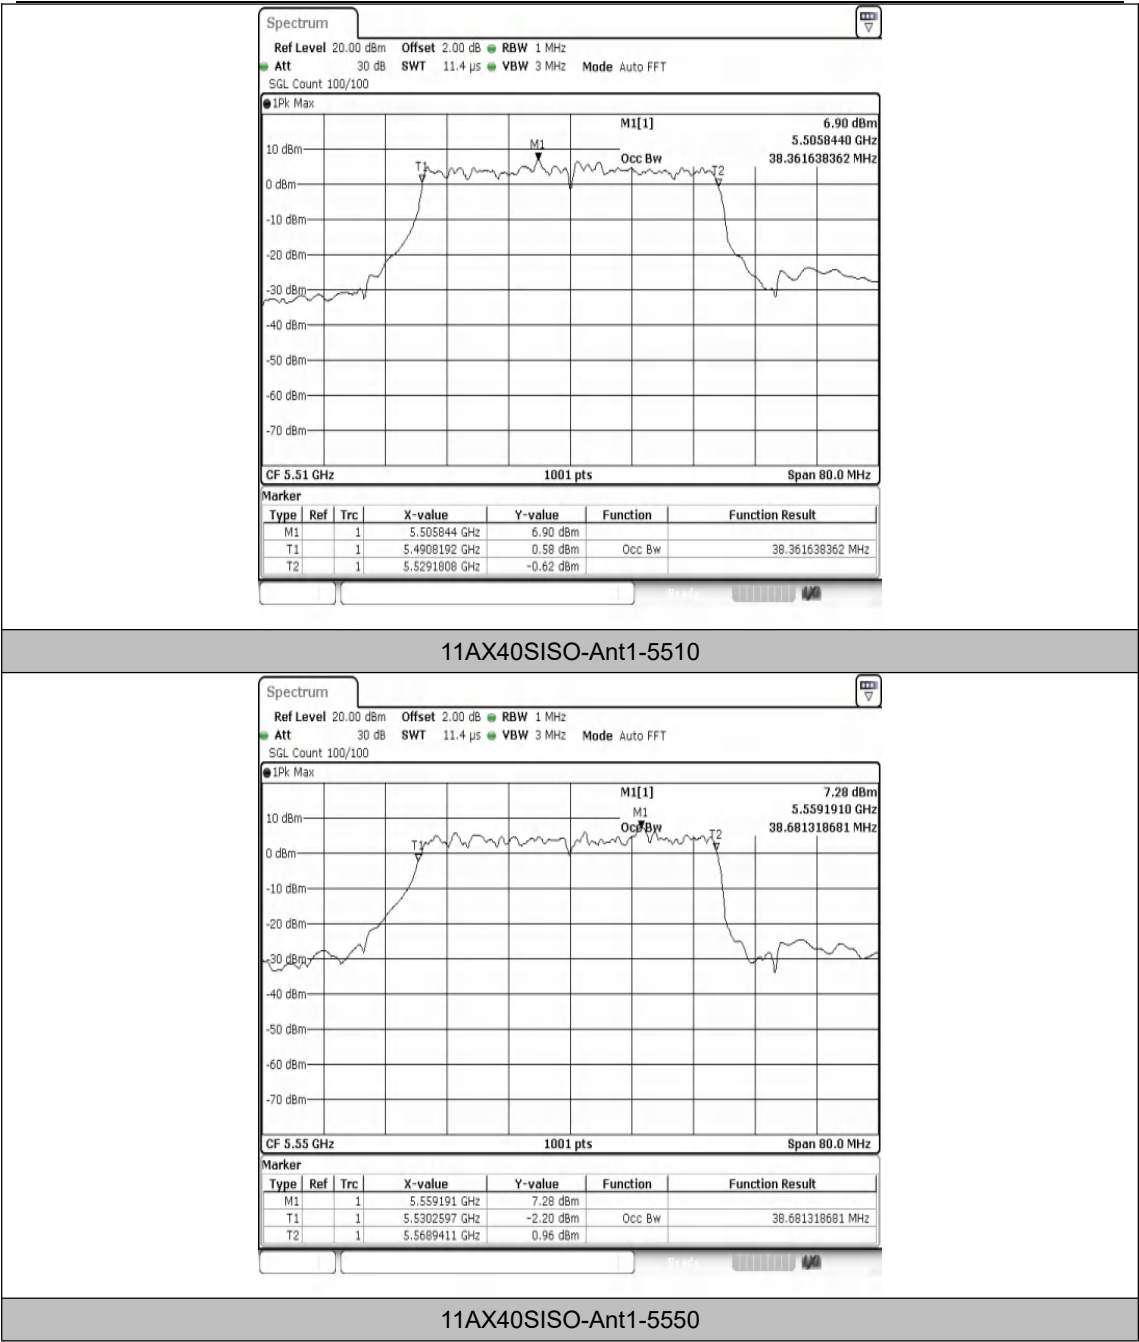

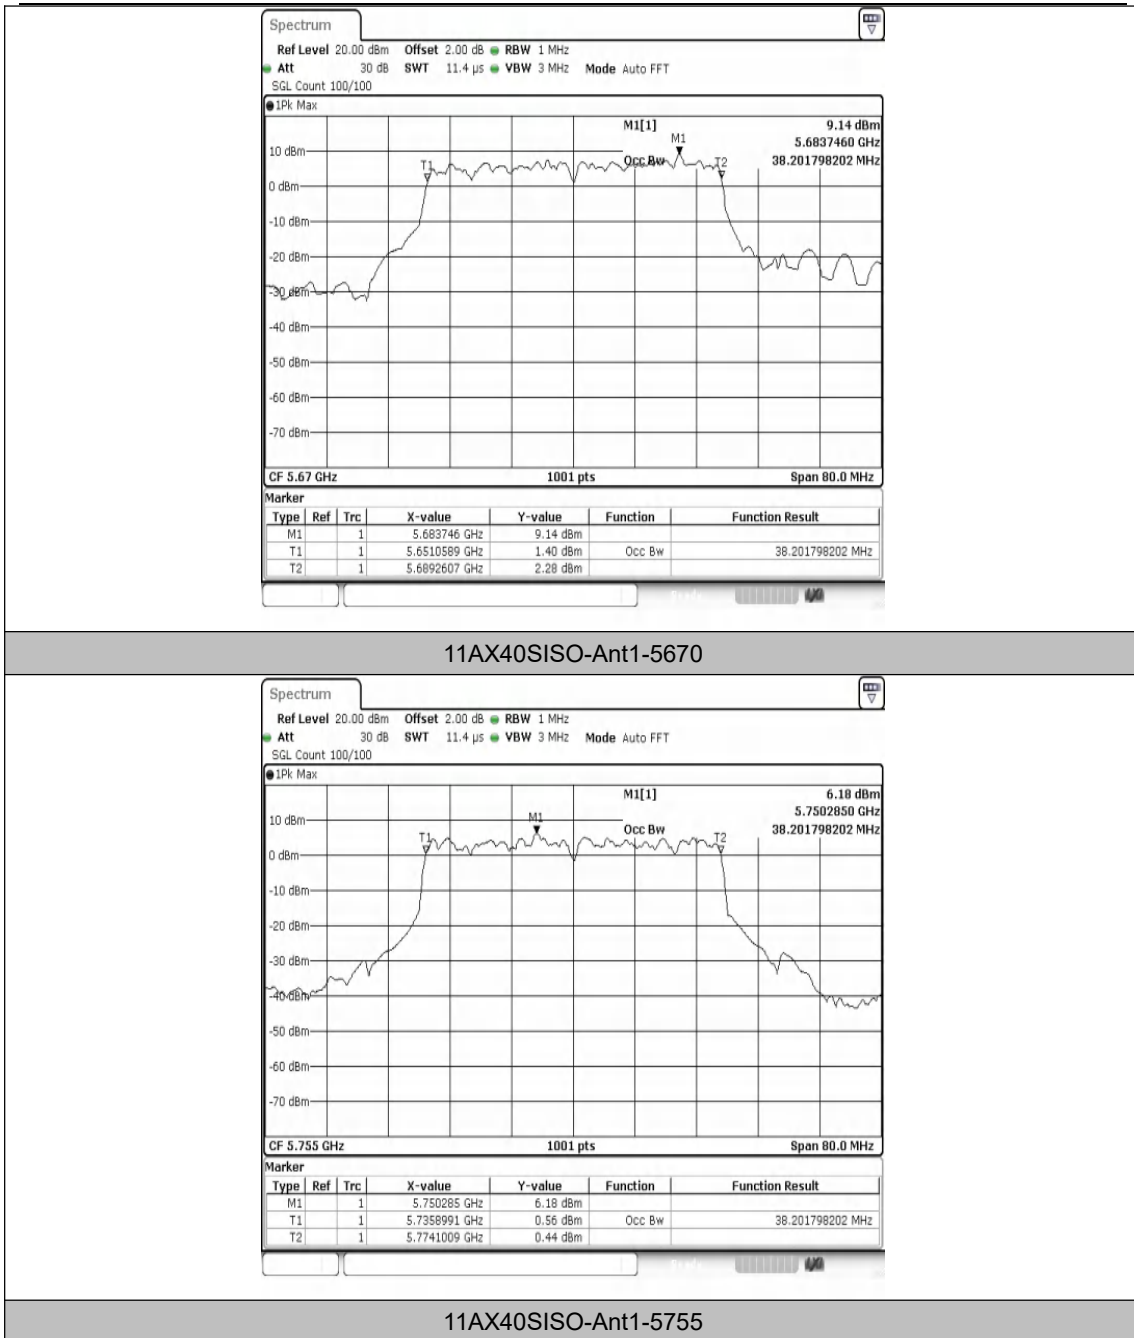

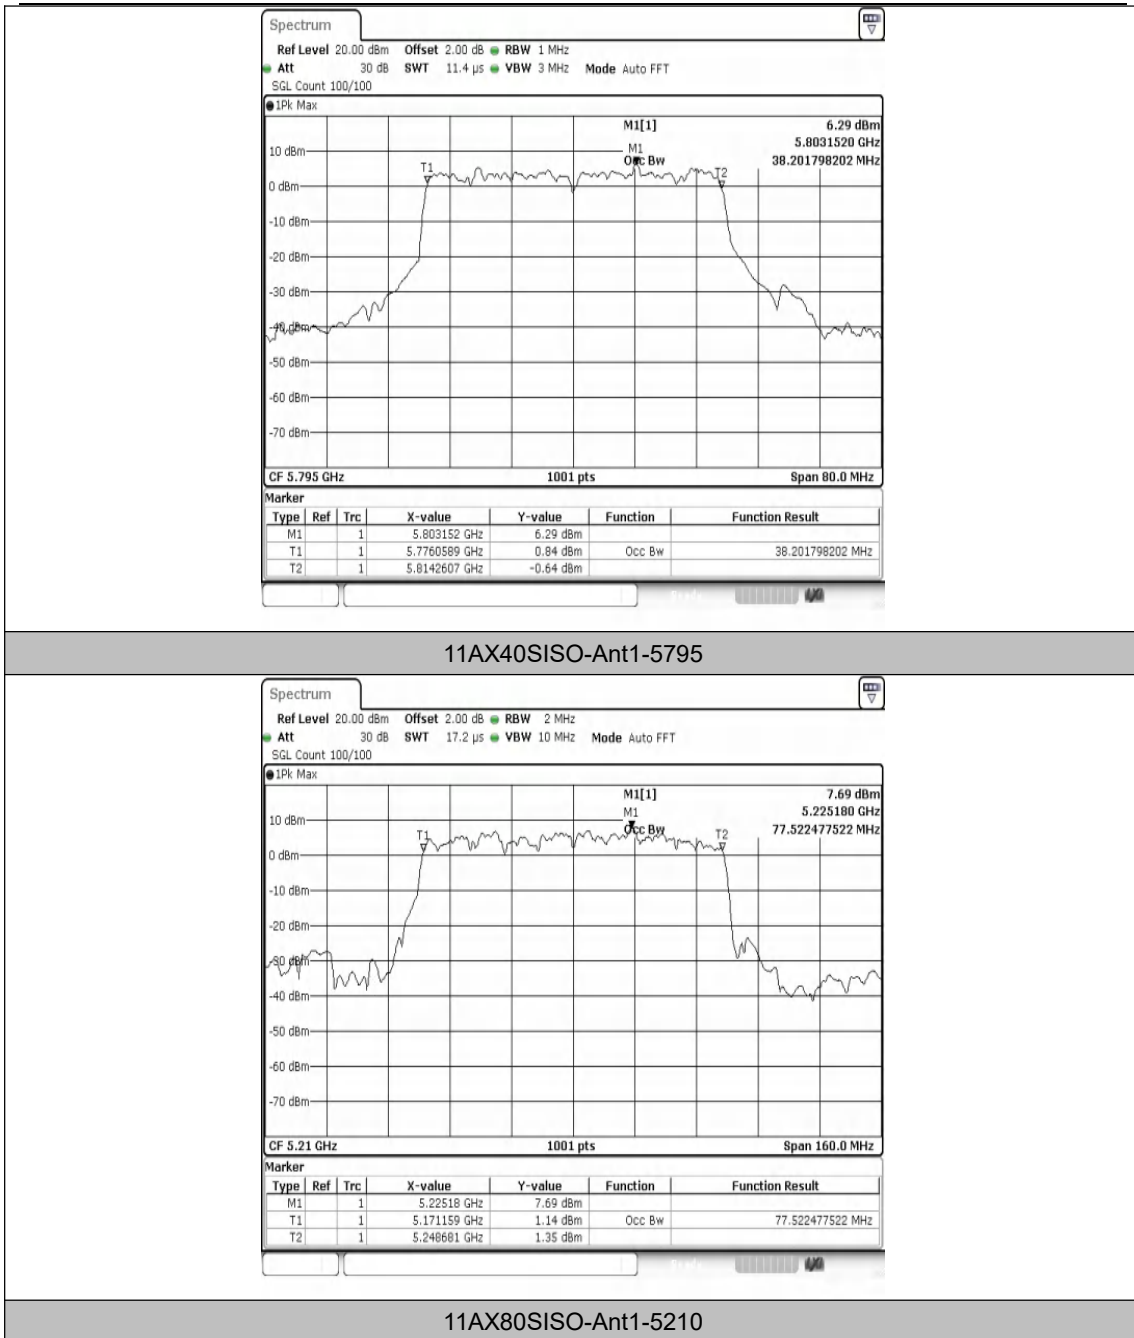

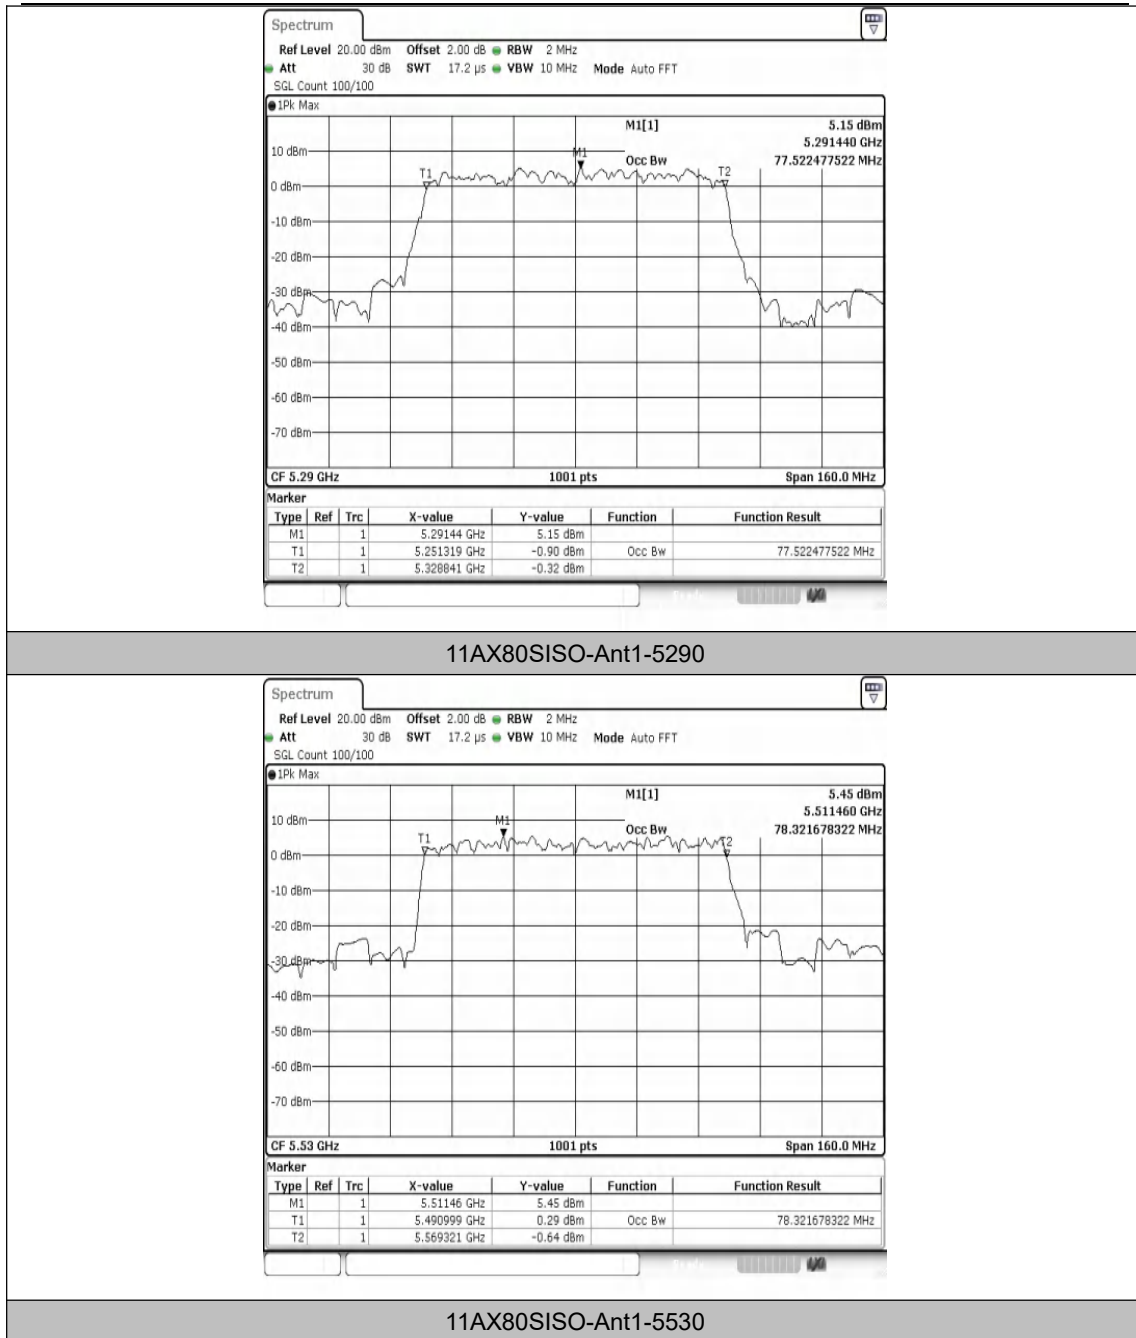

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com