



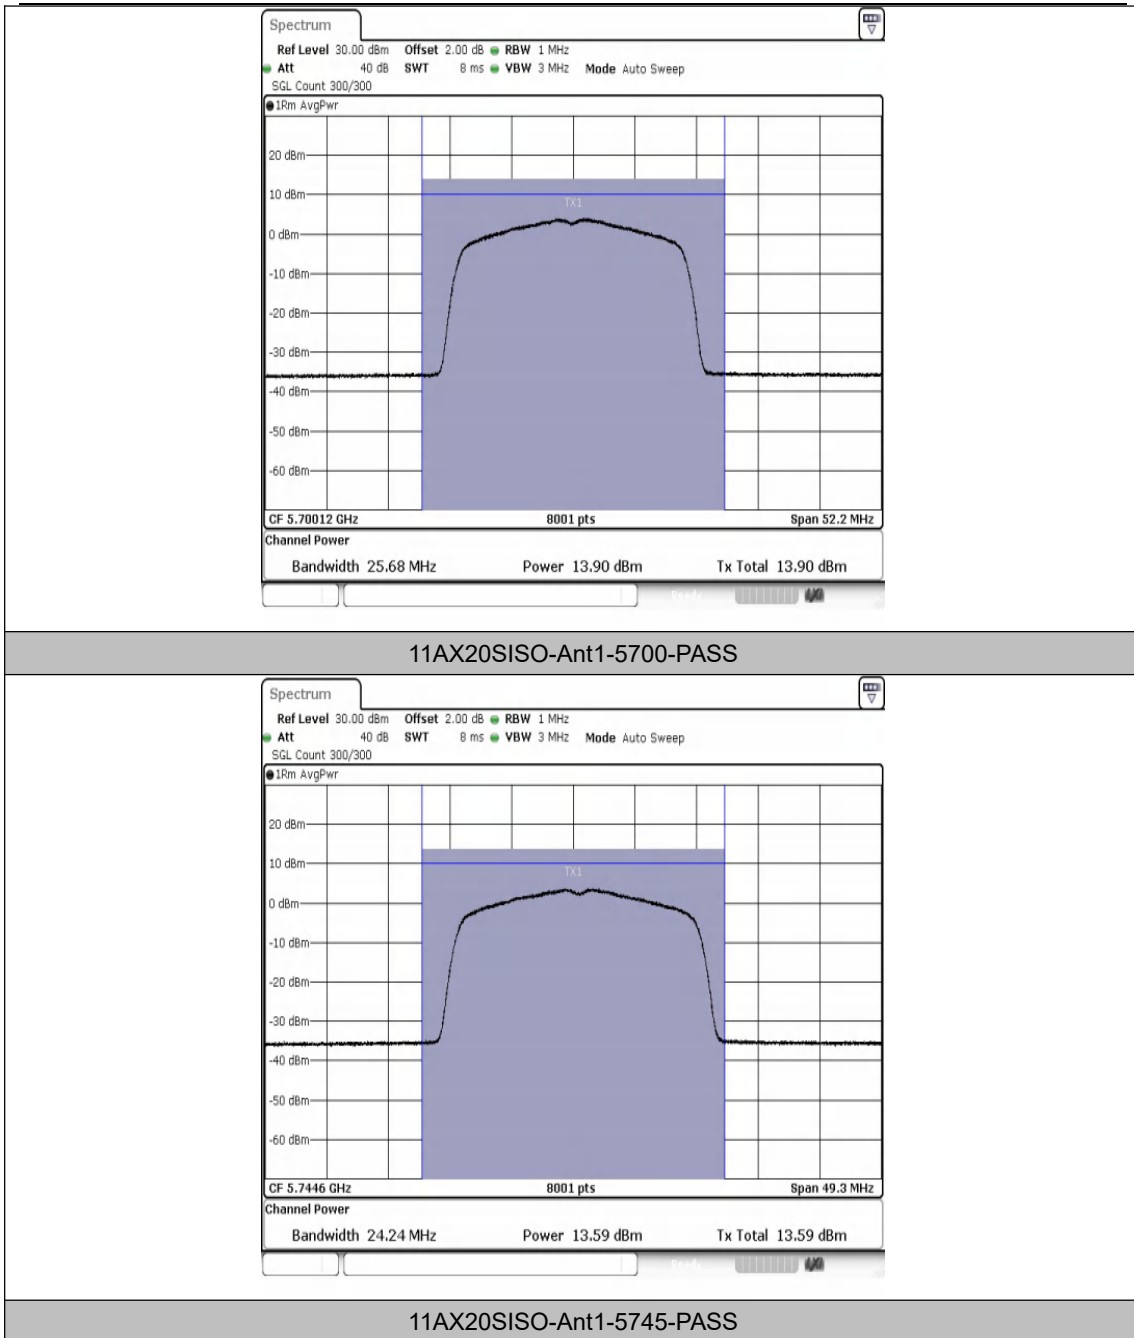

**Shenzhen Anbotek Compliance Laboratory Limited**

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

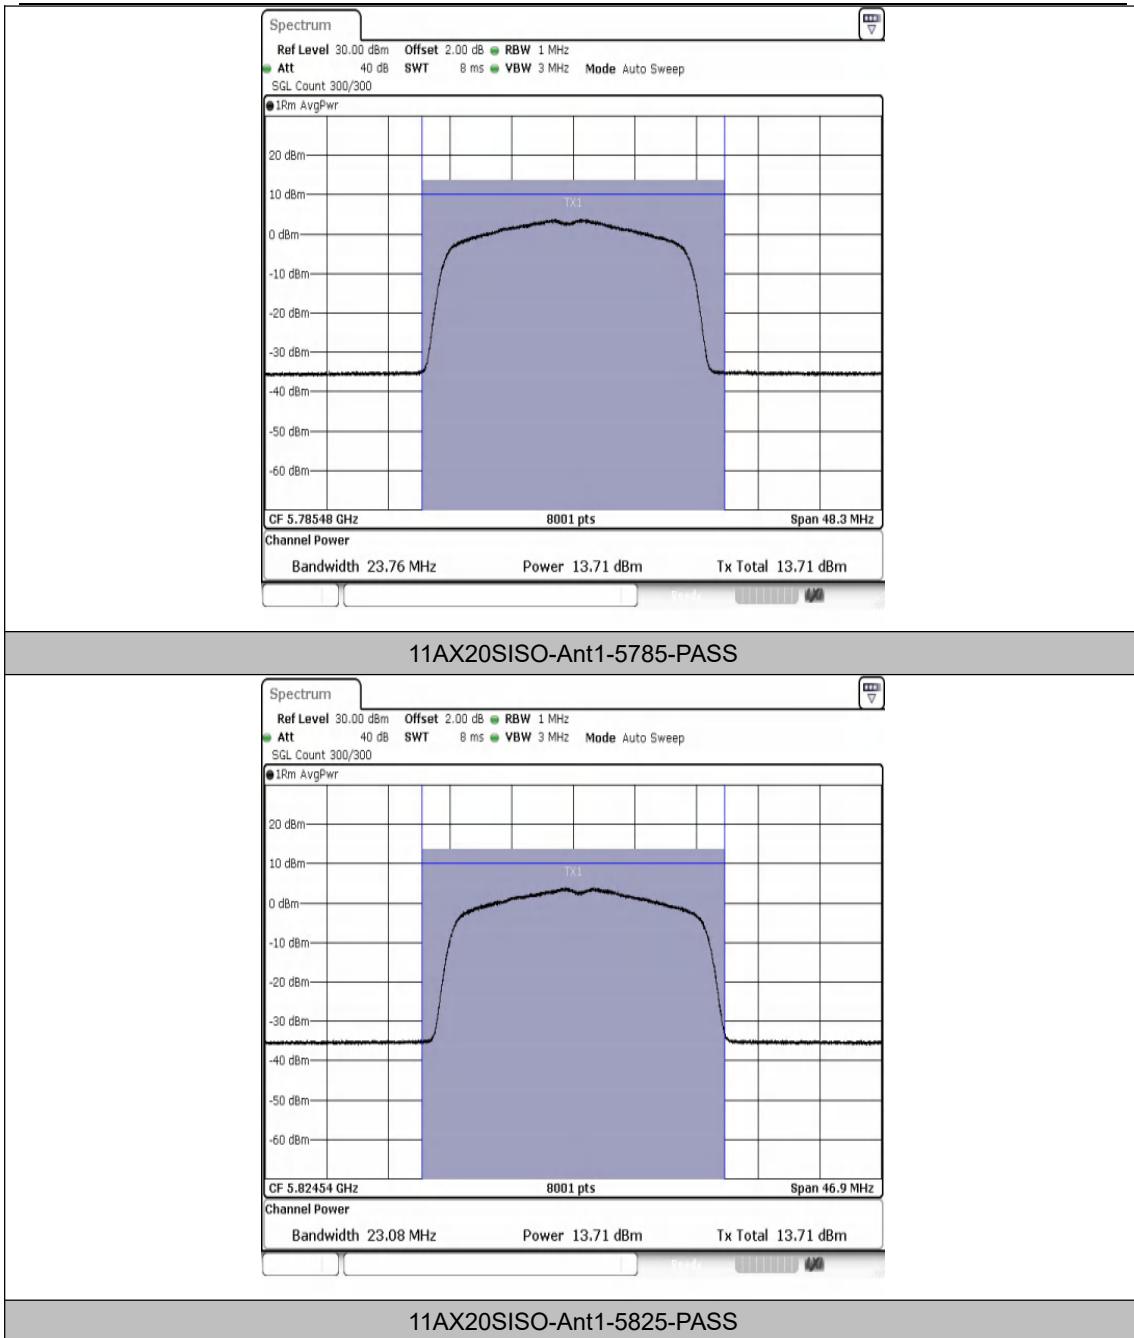


**Shenzhen Anbotek Compliance Laboratory Limited**

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

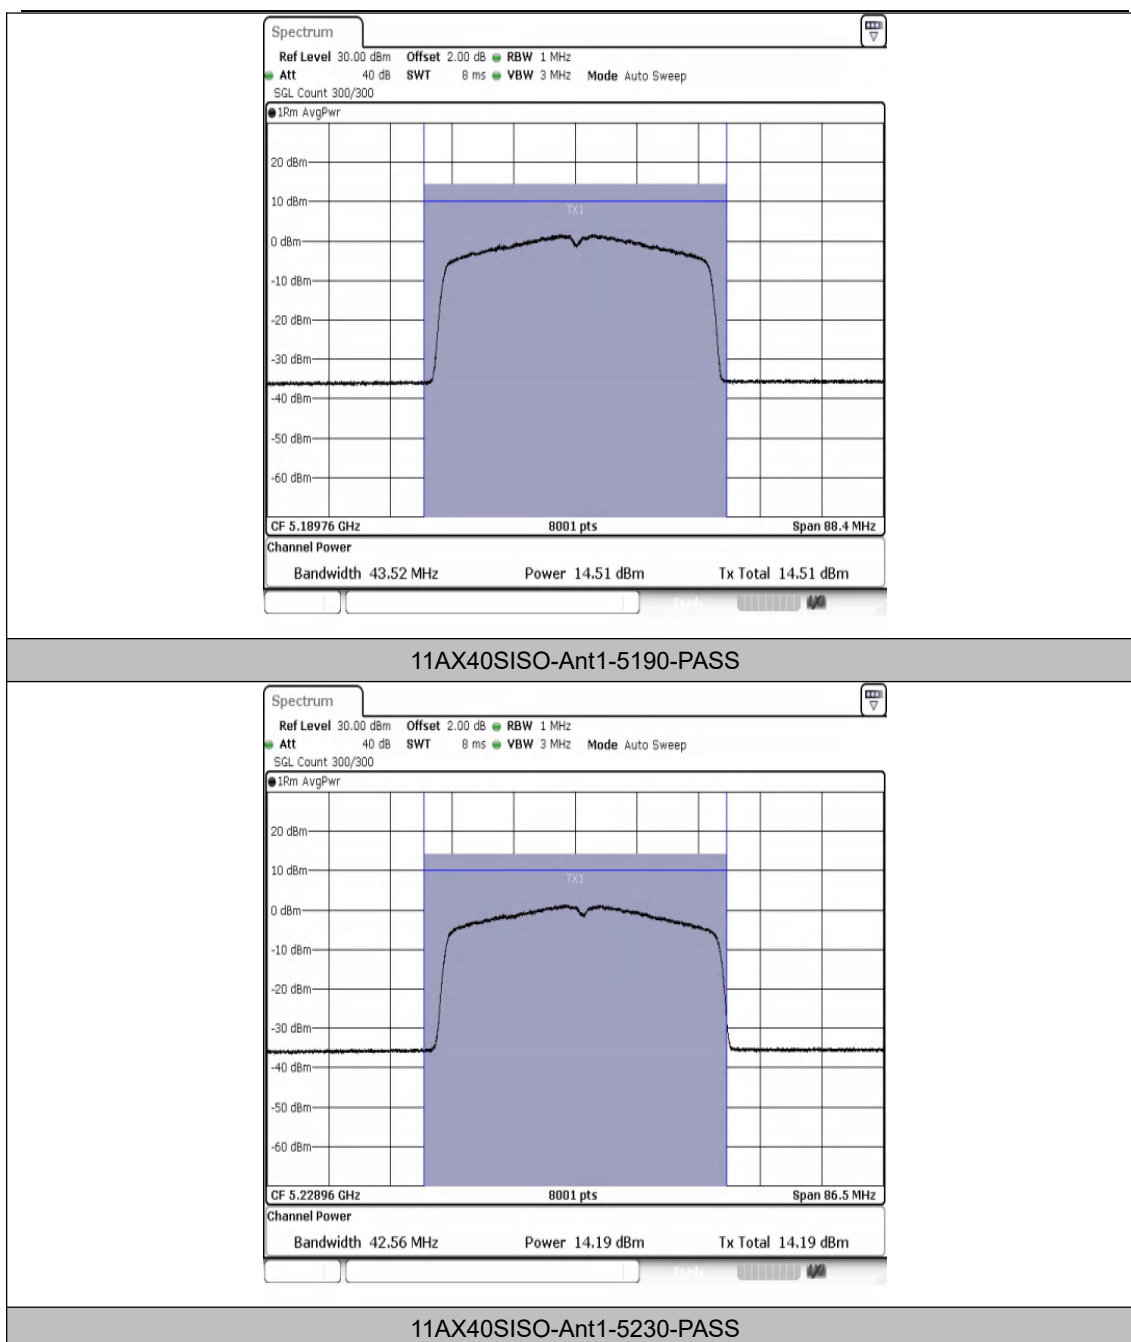


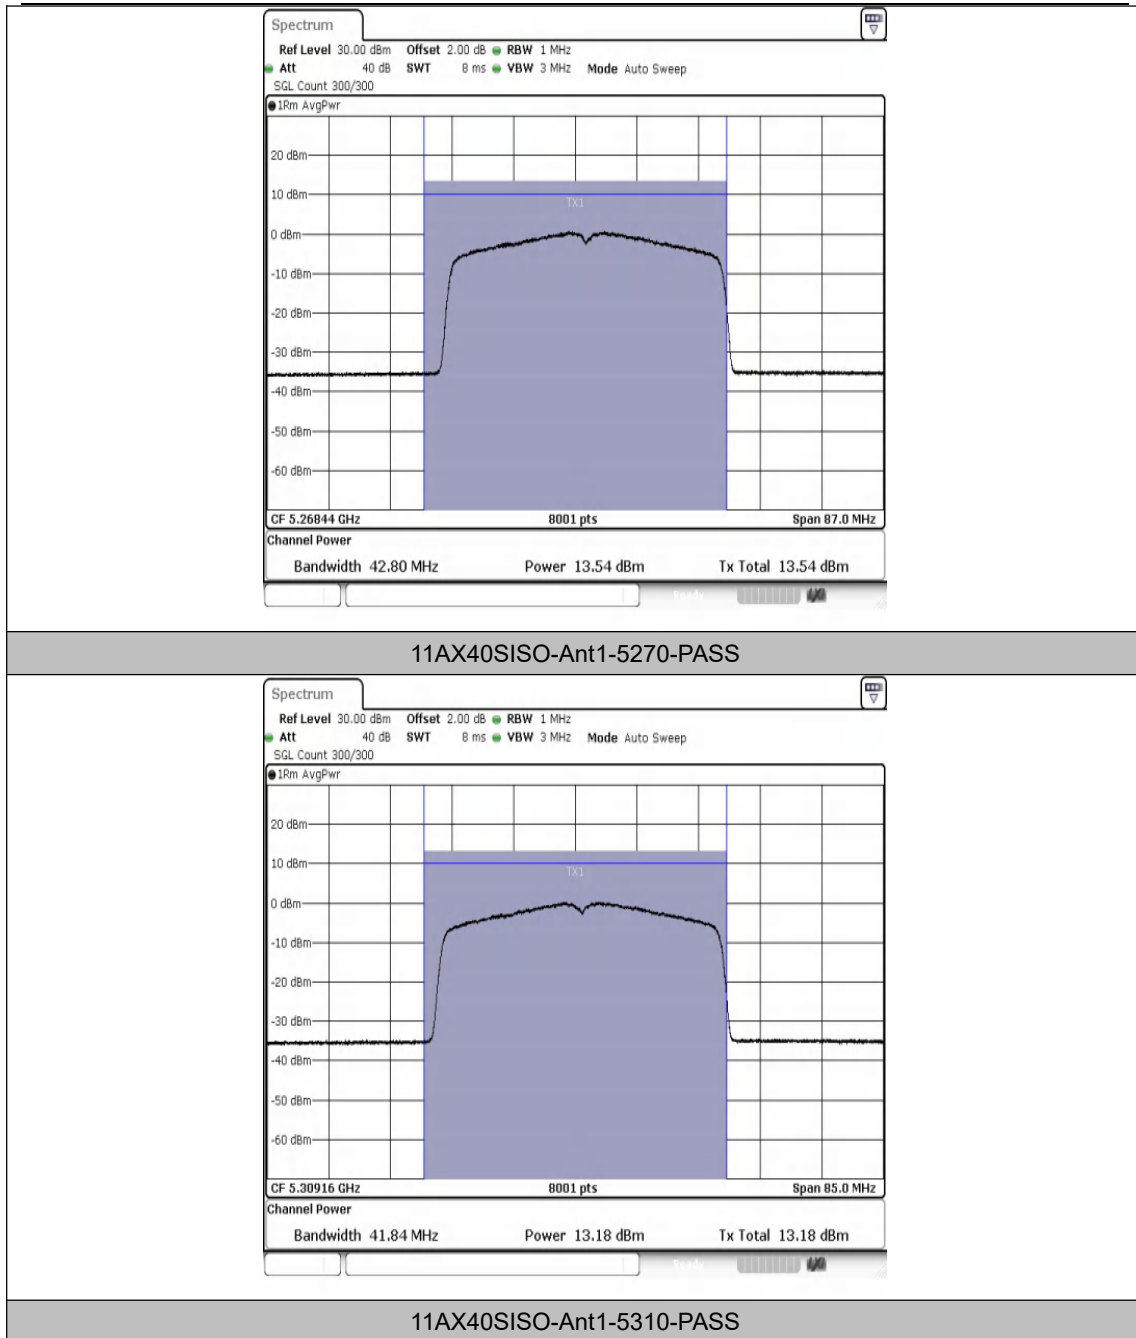

**Shenzhen Anbotek Compliance Laboratory Limited**

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

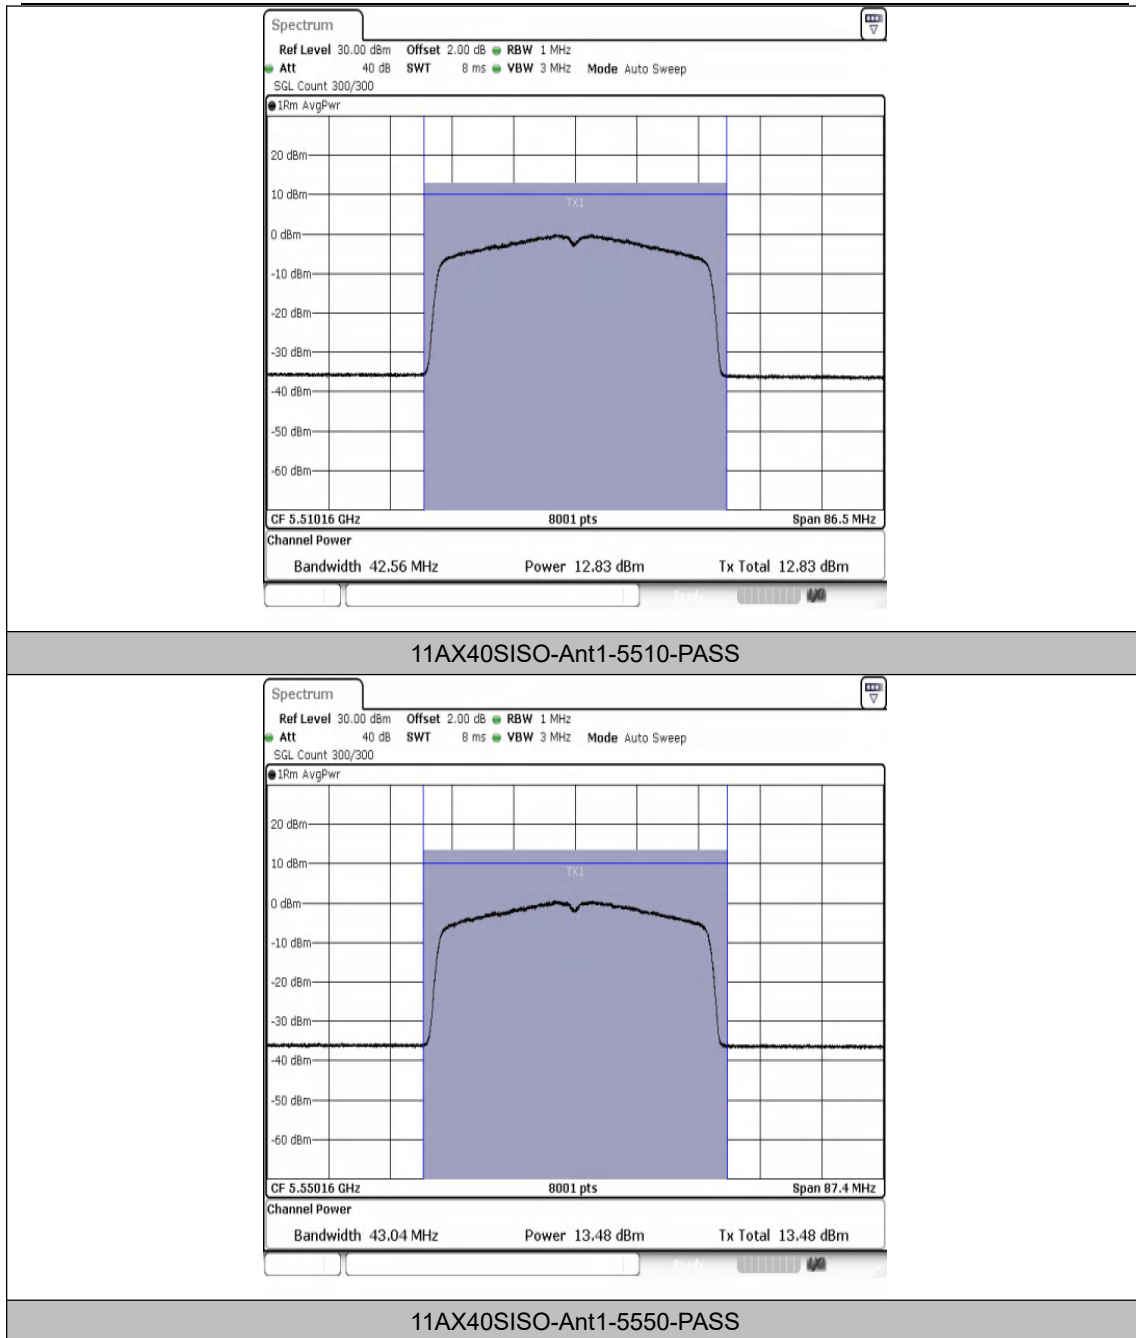

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

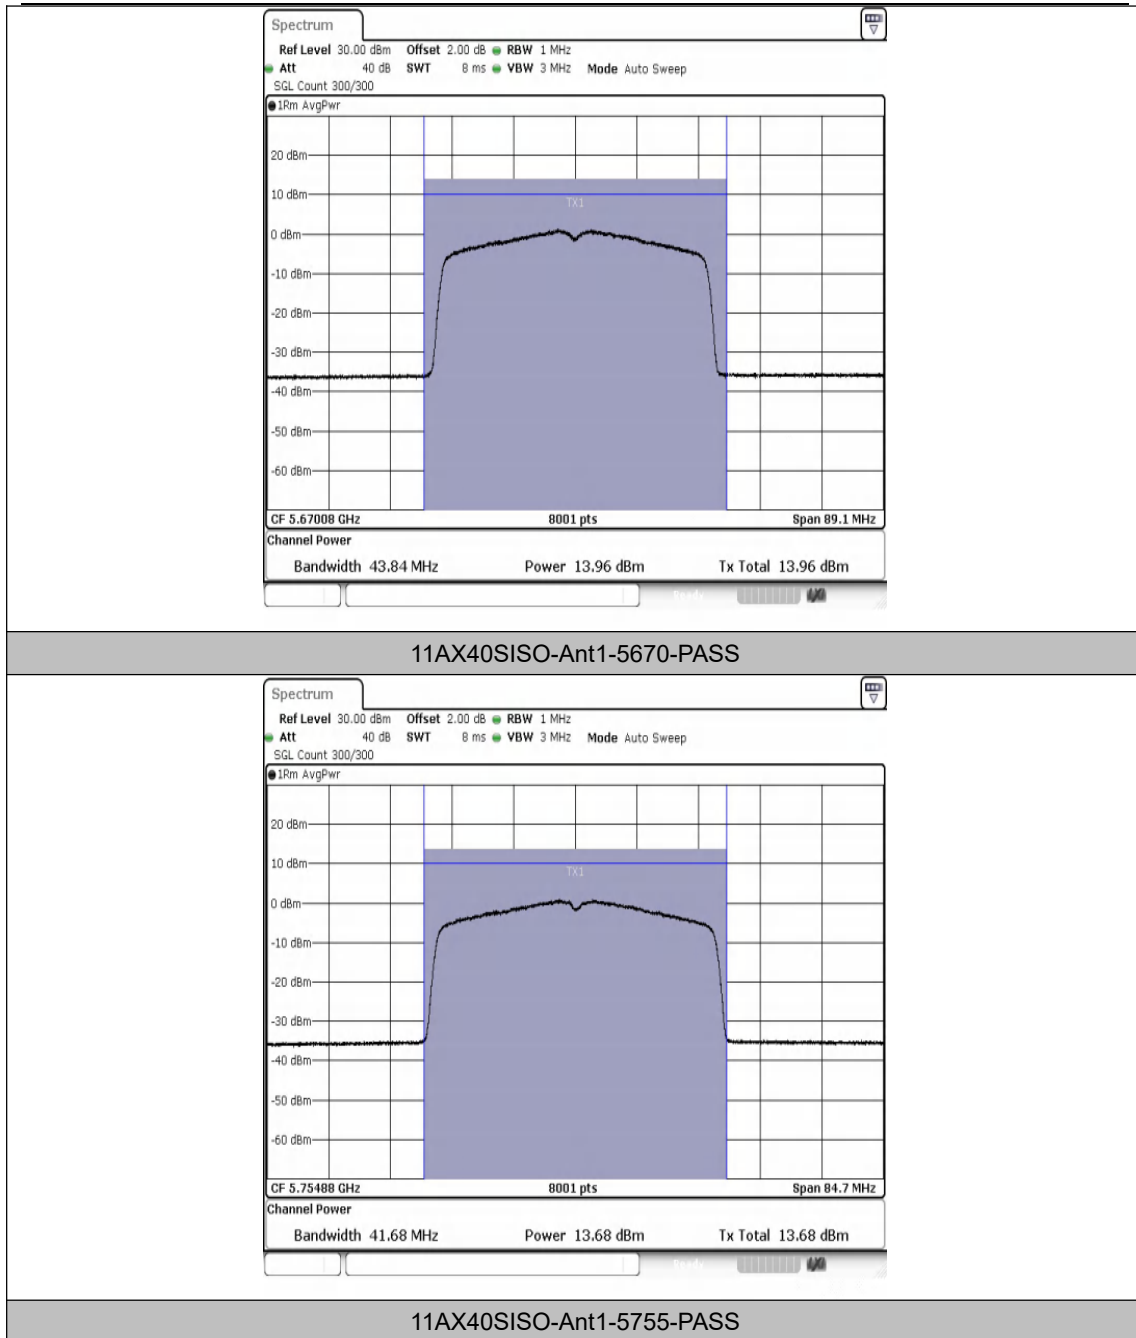


**Shenzhen Anbotek Compliance Laboratory Limited**

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

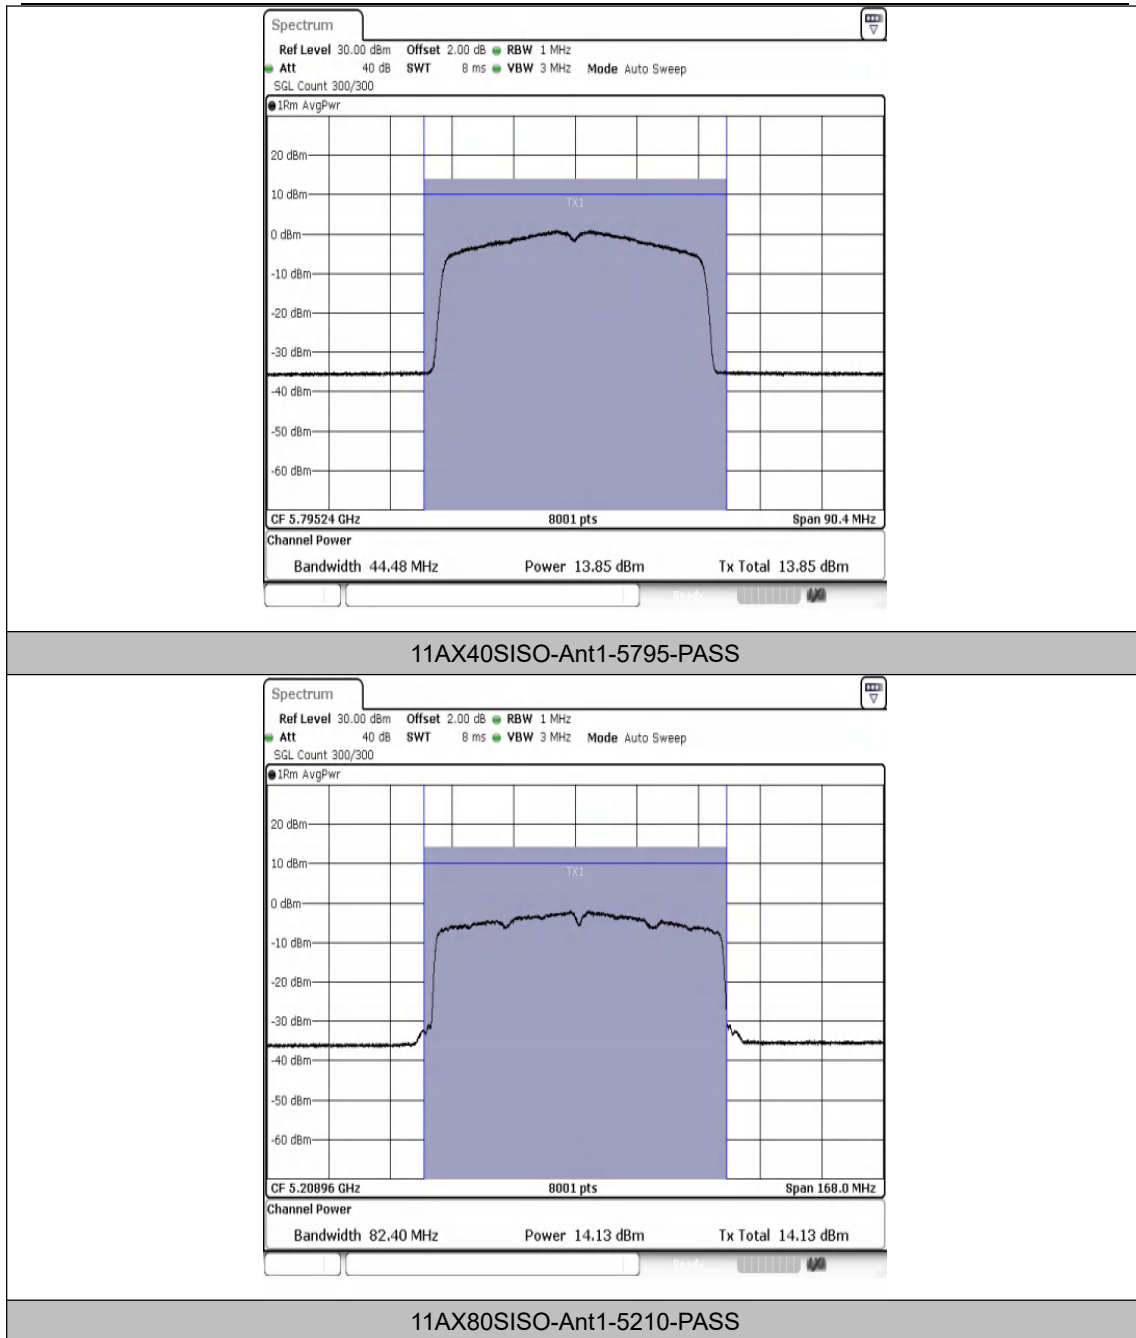


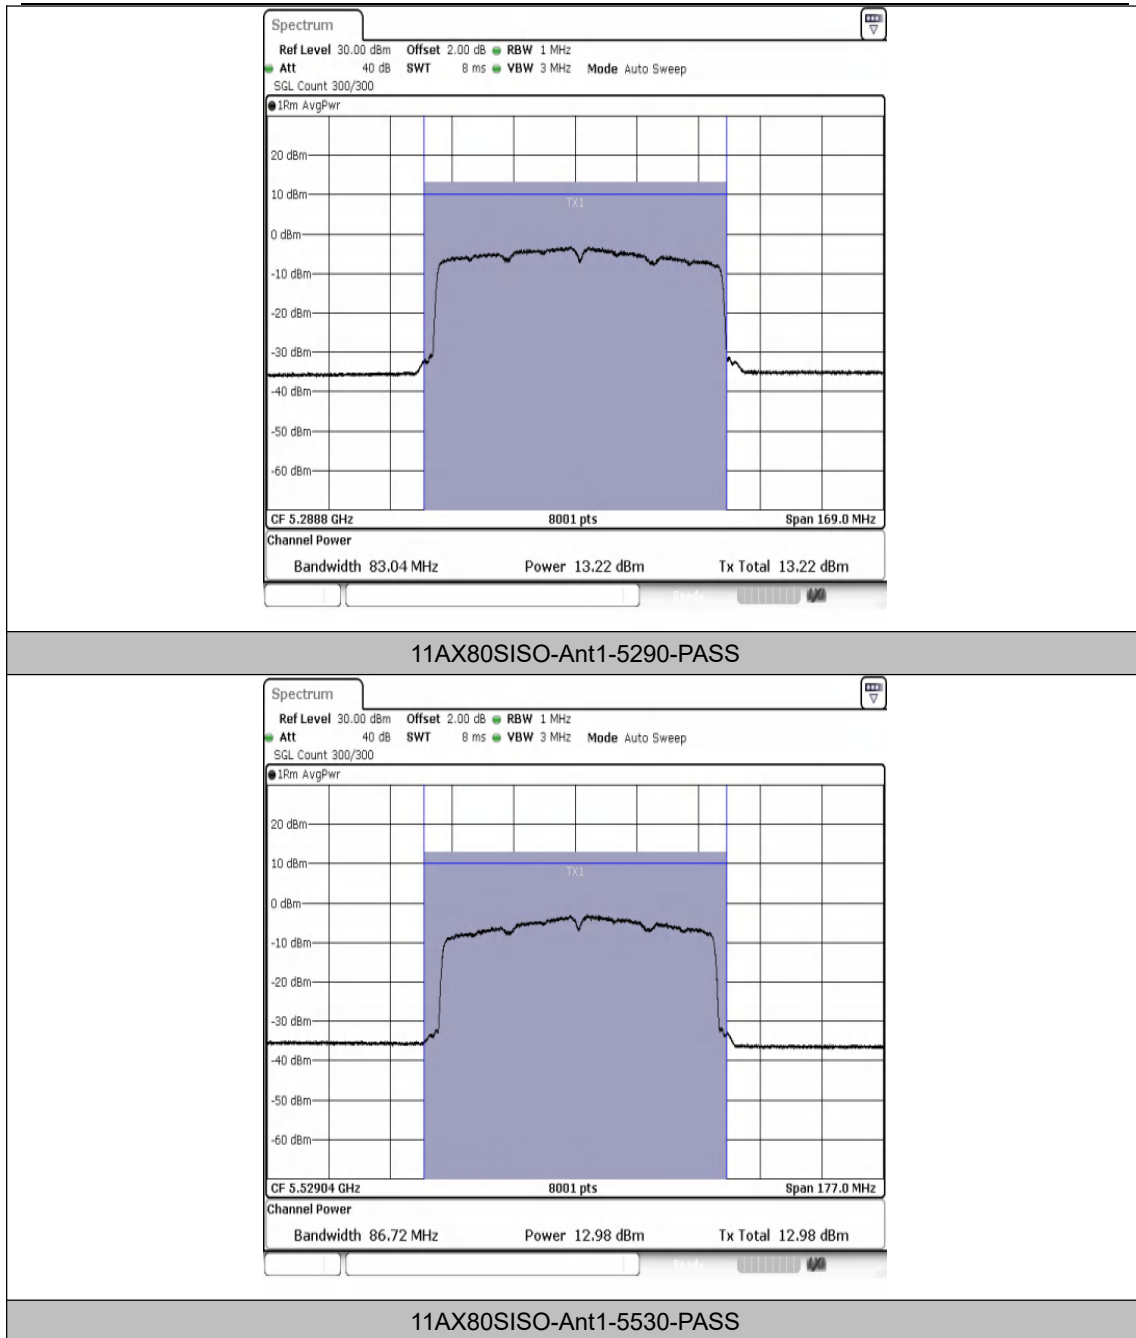

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

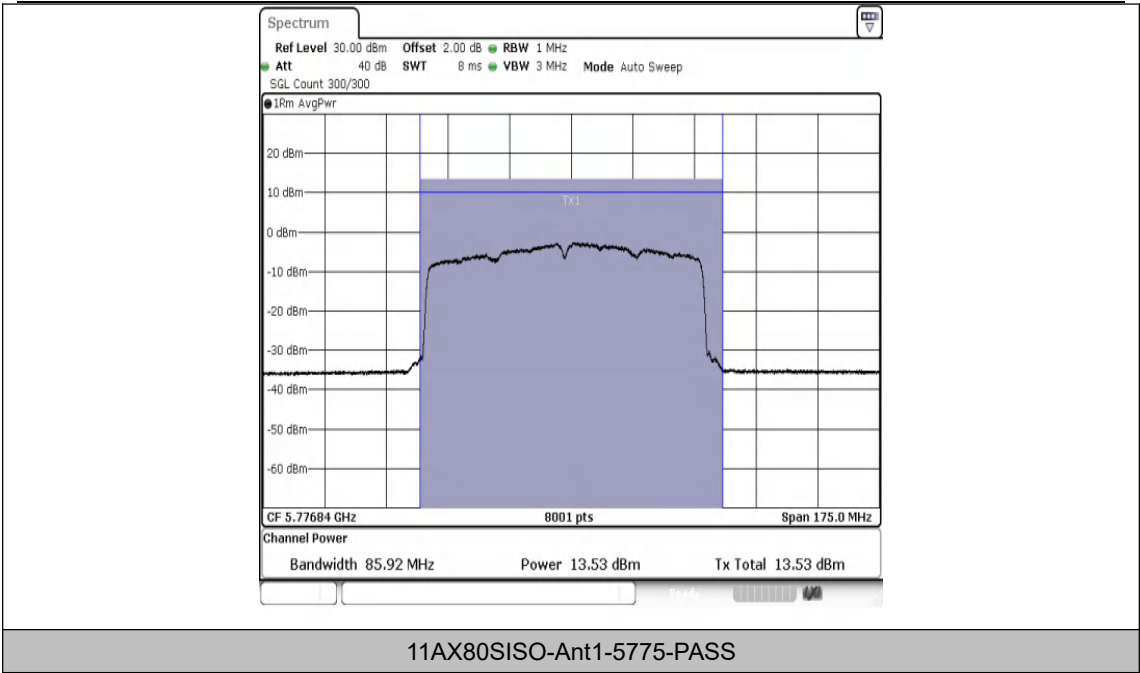

**Shenzhen Anbotek Compliance Laboratory Limited**

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500    web: [www.anbotek.com](http://www.anbotek.com)    E-mail: [service@anbotek.com](mailto:service@anbotek.com)

## Appendix D: Maximum Power Spectral Density

### Test Result B1/2/3

| Test Mode  | Antenna | Frequency[MHz] | Result [dBm/MHz] | Limit[dBm/MHz] | Verdict |
|------------|---------|----------------|------------------|----------------|---------|
| 11A        | Ant1    | 5180           | 4.46             | ≤11.00         | PASS    |
| 11A        | Ant1    | 5200           | 4.32             | ≤11.00         | PASS    |
| 11A        | Ant1    | 5240           | 4.19             | ≤11.00         | PASS    |
| 11A        | Ant1    | 5260           | 3.40             | ≤11.00         | PASS    |
| 11A        | Ant1    | 5280           | 3.53             | ≤11.00         | PASS    |
| 11A        | Ant1    | 5320           | 3.15             | ≤11.00         | PASS    |
| 11A        | Ant1    | 5500           | 2.81             | ≤11.00         | PASS    |
| 11A        | Ant1    | 5580           | 4.40             | ≤11.00         | PASS    |
| 11A        | Ant1    | 5700           | 4.48             | ≤11.00         | PASS    |
| 11N20SISO  | Ant1    | 5180           | 4.38             | ≤11.00         | PASS    |
| 11N20SISO  | Ant1    | 5200           | 4.35             | ≤11.00         | PASS    |
| 11N20SISO  | Ant1    | 5240           | 4.35             | ≤11.00         | PASS    |
| 11N20SISO  | Ant1    | 5260           | 3.52             | ≤11.00         | PASS    |
| 11N20SISO  | Ant1    | 5280           | 3.22             | ≤11.00         | PASS    |
| 11N20SISO  | Ant1    | 5320           | 3.12             | ≤11.00         | PASS    |
| 11N20SISO  | Ant1    | 5500           | 2.28             | ≤11.00         | PASS    |
| 11N20SISO  | Ant1    | 5580           | 4.57             | ≤11.00         | PASS    |
| 11N20SISO  | Ant1    | 5700           | 4.04             | ≤11.00         | PASS    |
| 11N40SISO  | Ant1    | 5190           | 1.61             | ≤11.00         | PASS    |
| 11N40SISO  | Ant1    | 5230           | 0.99             | ≤11.00         | PASS    |
| 11N40SISO  | Ant1    | 5270           | -0.03            | ≤11.00         | PASS    |
| 11N40SISO  | Ant1    | 5310           | 0.24             | ≤11.00         | PASS    |
| 11N40SISO  | Ant1    | 5510           | -0.70            | ≤11.00         | PASS    |
| 11N40SISO  | Ant1    | 5550           | 0.61             | ≤11.00         | PASS    |
| 11N40SISO  | Ant1    | 5670           | 1.10             | ≤11.00         | PASS    |
| 11AC20SISO | Ant1    | 5180           | 4.71             | ≤11.00         | PASS    |
| 11AC20SISO | Ant1    | 5200           | 5.17             | ≤11.00         | PASS    |
| 11AC20SISO | Ant1    | 5240           | 3.86             | ≤11.00         | PASS    |
| 11AC20SISO | Ant1    | 5260           | 3.85             | ≤11.00         | PASS    |
| 11AC20SISO | Ant1    | 5280           | 2.76             | ≤11.00         | PASS    |
| 11AC20SISO | Ant1    | 5320           | 3.36             | ≤11.00         | PASS    |
| 11AC20SISO | Ant1    | 5500           | 2.86             | ≤11.00         | PASS    |
| 11AC20SISO | Ant1    | 5580           | 4.09             | ≤11.00         | PASS    |
| 11AC20SISO | Ant1    | 5700           | 4.01             | ≤11.00         | PASS    |
| 11AC40SISO | Ant1    | 5190           | 1.73             | ≤11.00         | PASS    |
| 11AC40SISO | Ant1    | 5230           | 0.68             | ≤11.00         | PASS    |
| 11AC40SISO | Ant1    | 5270           | 0.68             | ≤11.00         | PASS    |

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

|            |      |      |       |        |      |
|------------|------|------|-------|--------|------|
| 11AC40SISO | Ant1 | 5310 | 0.04  | ≤11.00 | PASS |
| 11AC40SISO | Ant1 | 5510 | 0.48  | ≤11.00 | PASS |
| 11AC40SISO | Ant1 | 5550 | 0.19  | ≤11.00 | PASS |
| 11AC40SISO | Ant1 | 5670 | 1.04  | ≤11.00 | PASS |
| 11AC80SISO | Ant1 | 5210 | -1.98 | ≤11.00 | PASS |
| 11AC80SISO | Ant1 | 5290 | -2.98 | ≤11.00 | PASS |
| 11AC80SISO | Ant1 | 5530 | -3.08 | ≤11.00 | PASS |
| 11AX20SISO | Ant1 | 5180 | 4.05  | ≤11.00 | PASS |
| 11AX20SISO | Ant1 | 5200 | 4.20  | ≤11.00 | PASS |
| 11AX20SISO | Ant1 | 5240 | 4.03  | ≤11.00 | PASS |
| 11AX20SISO | Ant1 | 5260 | 4.01  | ≤11.00 | PASS |
| 11AX20SISO | Ant1 | 5280 | 3.65  | ≤11.00 | PASS |
| 11AX20SISO | Ant1 | 5320 | 3.60  | ≤11.00 | PASS |
| 11AX20SISO | Ant1 | 5500 | 2.18  | ≤11.00 | PASS |
| 11AX20SISO | Ant1 | 5580 | 3.89  | ≤11.00 | PASS |
| 11AX20SISO | Ant1 | 5700 | 4.01  | ≤11.00 | PASS |
| 11AX40SISO | Ant1 | 5190 | 1.39  | ≤11.00 | PASS |
| 11AX40SISO | Ant1 | 5230 | 1.01  | ≤11.00 | PASS |
| 11AX40SISO | Ant1 | 5270 | 0.51  | ≤11.00 | PASS |
| 11AX40SISO | Ant1 | 5310 | 0.46  | ≤11.00 | PASS |
| 11AX40SISO | Ant1 | 5510 | -0.03 | ≤11.00 | PASS |
| 11AX40SISO | Ant1 | 5550 | 0.83  | ≤11.00 | PASS |
| 11AX40SISO | Ant1 | 5670 | 1.20  | ≤11.00 | PASS |
| 11AX80SISO | Ant1 | 5210 | -1.87 | ≤11.00 | PASS |
| 11AX80SISO | Ant1 | 5290 | -2.95 | ≤11.00 | PASS |
| 11AX80SISO | Ant1 | 5530 | -2.75 | ≤11.00 | PASS |


Note: 1.The cable loss are compensated in the graph.

## Test Result B4

| Test Mode  | Antenna | Frequency[MHz] | Result [dBm/500KHz] | Limit[dBm/500KHz] | Verdict |
|------------|---------|----------------|---------------------|-------------------|---------|
| 11A        | Ant1    | 5745           | 0.75                | ≤30.00            | PASS    |
| 11A        | Ant1    | 5785           | 1.16                | ≤30.00            | PASS    |
| 11A        | Ant1    | 5825           | 1.48                | ≤30.00            | PASS    |
| 11N20SISO  | Ant1    | 5745           | 1.37                | ≤30.00            | PASS    |
| 11N20SISO  | Ant1    | 5785           | 1.99                | ≤30.00            | PASS    |
| 11N20SISO  | Ant1    | 5825           | 1.58                | ≤30.00            | PASS    |
| 11N40SISO  | Ant1    | 5755           | -4.18               | ≤30.00            | PASS    |
| 11N40SISO  | Ant1    | 5795           | -1.03               | ≤30.00            | PASS    |
| 11AC20SISO | Ant1    | 5745           | 0.89                | ≤30.00            | PASS    |
| 11AC20SISO | Ant1    | 5785           | 0.51                | ≤30.00            | PASS    |
| 11AC20SISO | Ant1    | 5825           | 1.16                | ≤30.00            | PASS    |
| 11AC40SISO | Ant1    | 5755           | -1.10               | ≤30.00            | PASS    |
| 11AC40SISO | Ant1    | 5795           | -1.51               | ≤30.00            | PASS    |
| 11AC80SISO | Ant1    | 5775           | -5.20               | ≤30.00            | PASS    |
| 11AX20SISO | Ant1    | 5745           | 0.71                | ≤30.00            | PASS    |
| 11AX20SISO | Ant1    | 5785           | 0.77                | ≤30.00            | PASS    |
| 11AX20SISO | Ant1    | 5825           | 1.36                | ≤30.00            | PASS    |
| 11AX40SISO | Ant1    | 5755           | -1.55               | ≤30.00            | PASS    |
| 11AX40SISO | Ant1    | 5795           | -1.84               | ≤30.00            | PASS    |
| 11AX80SISO | Ant1    | 5775           | -5.11               | ≤30.00            | PASS    |

Note: 1.The cable loss are compensated in the graph.


### Test Graphs B1/2/3

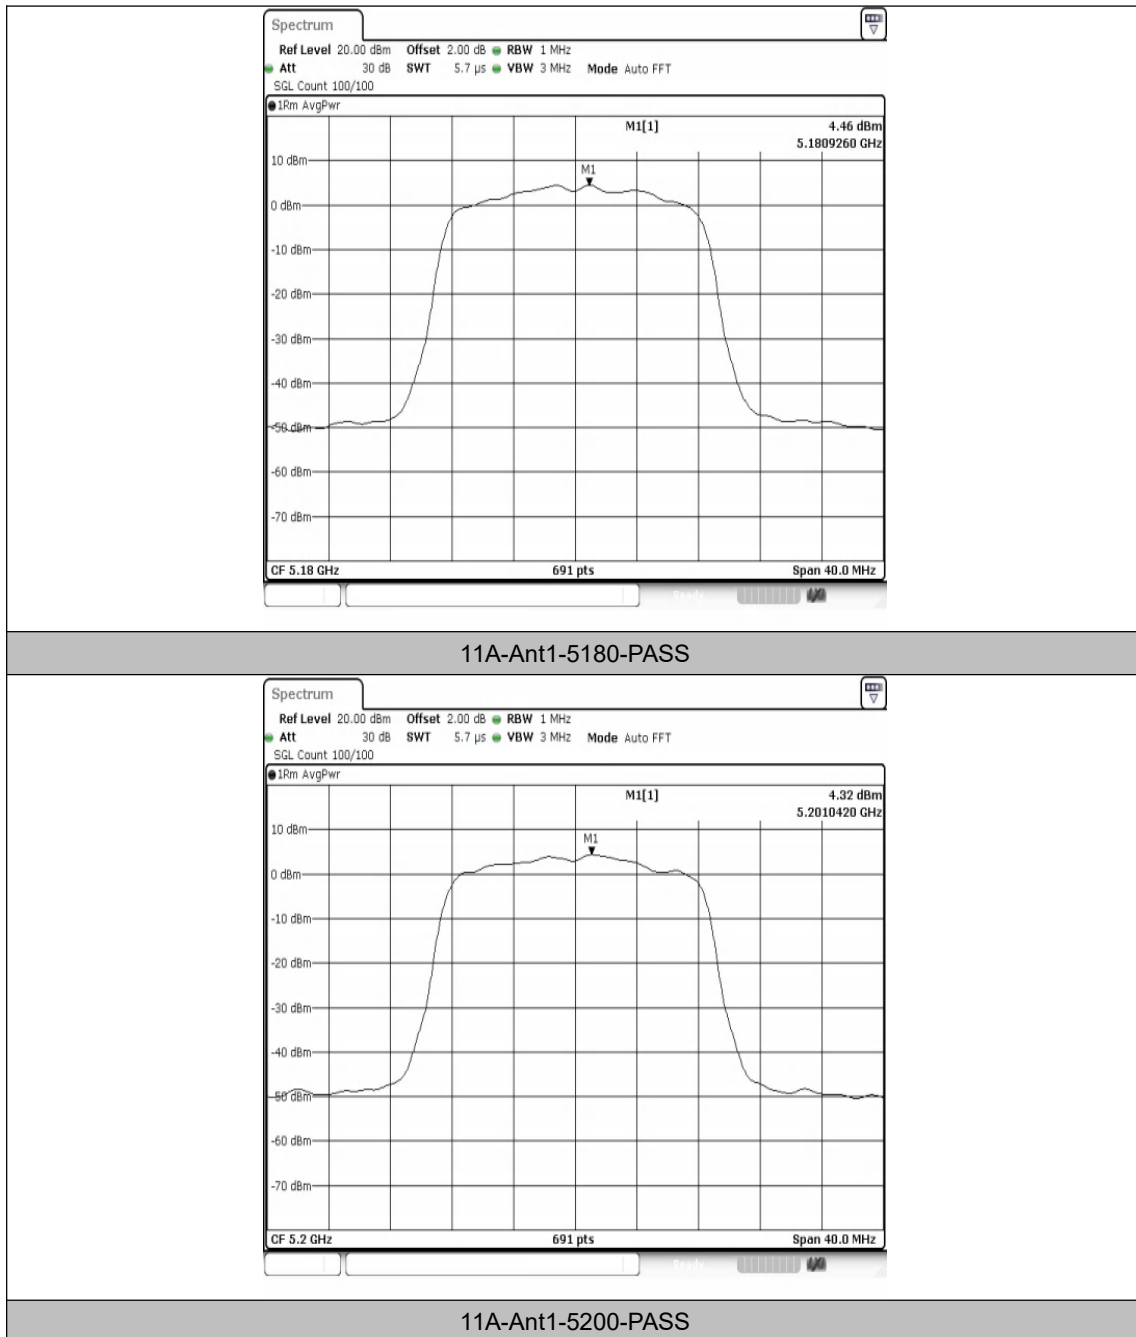

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

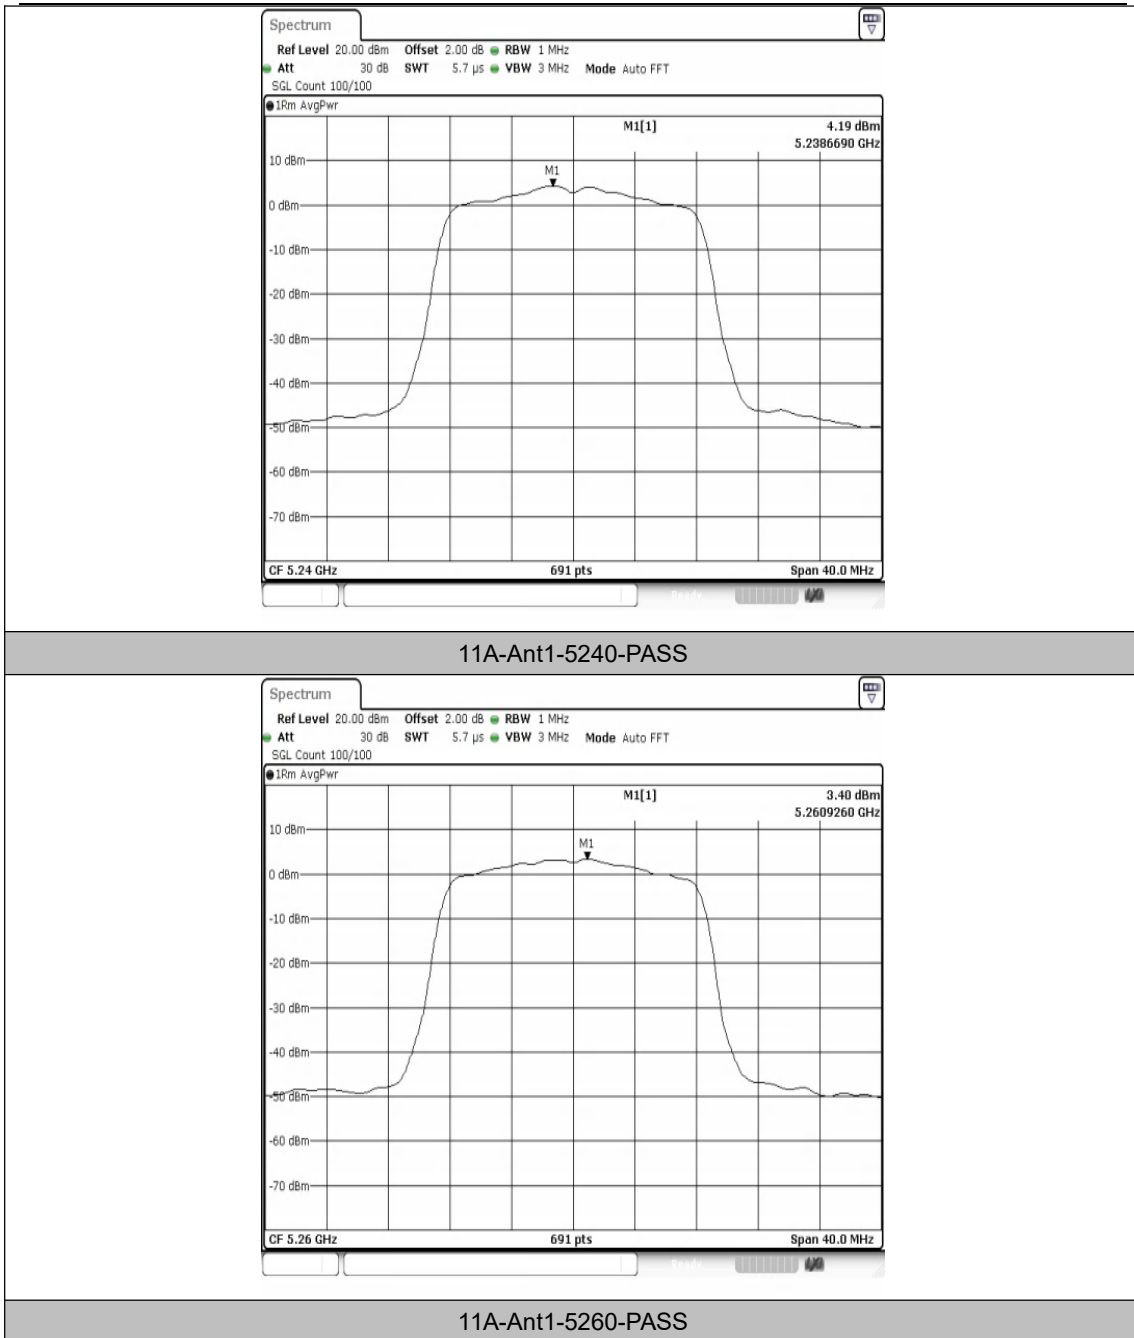

**Shenzhen Anbotek Compliance Laboratory Limited**

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

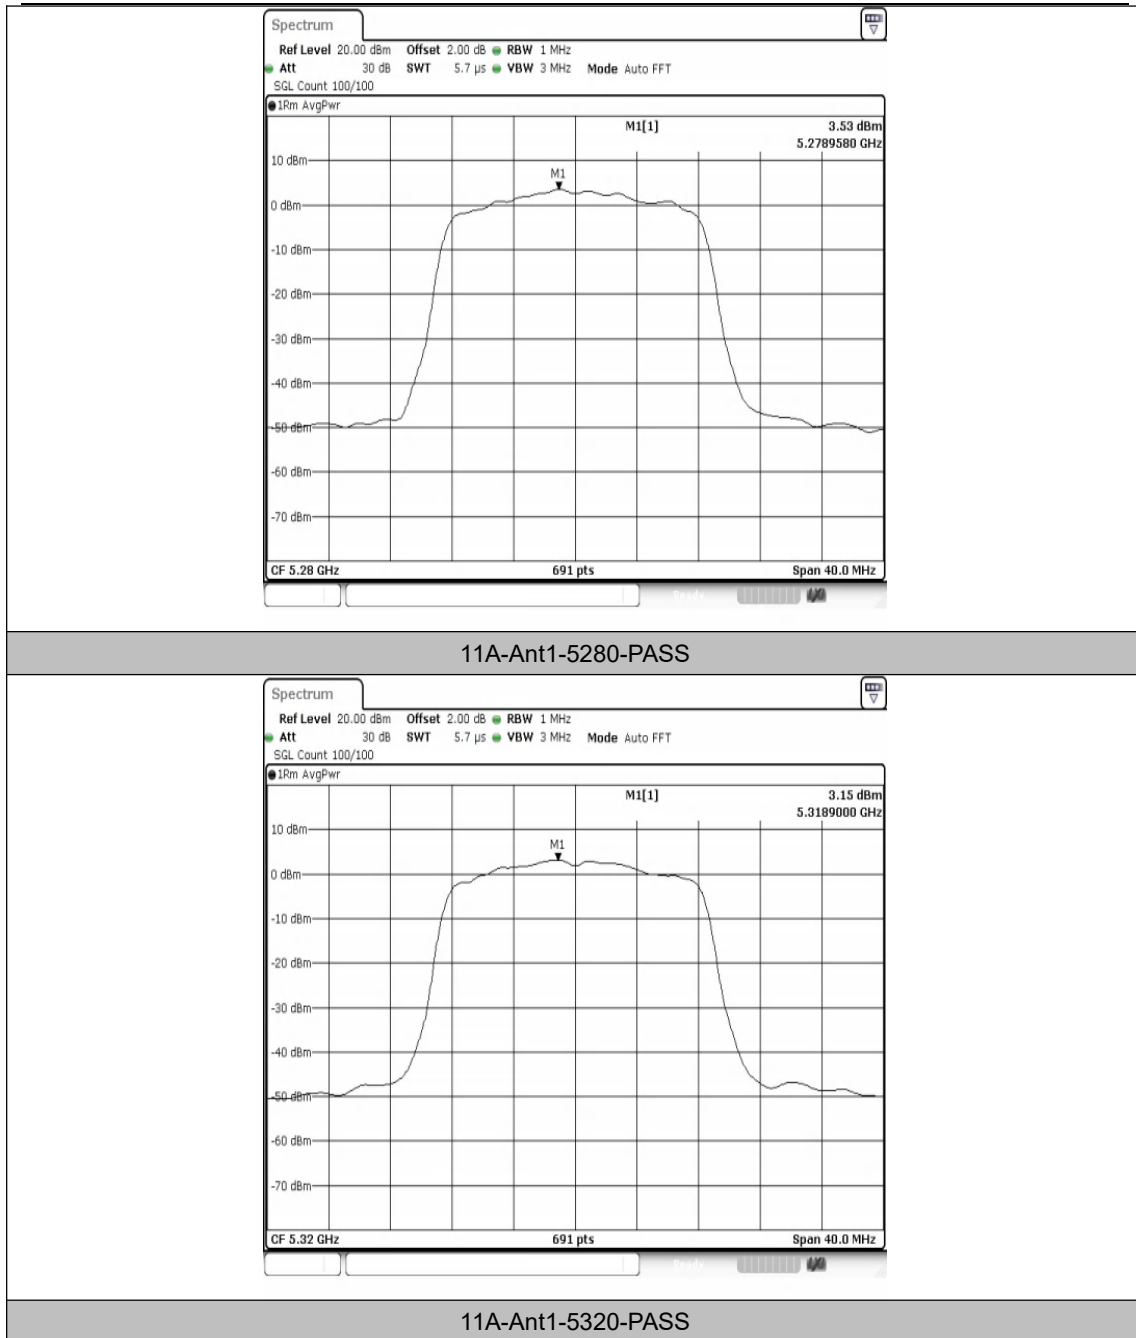

**Shenzhen Anbotek Compliance Laboratory Limited**

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

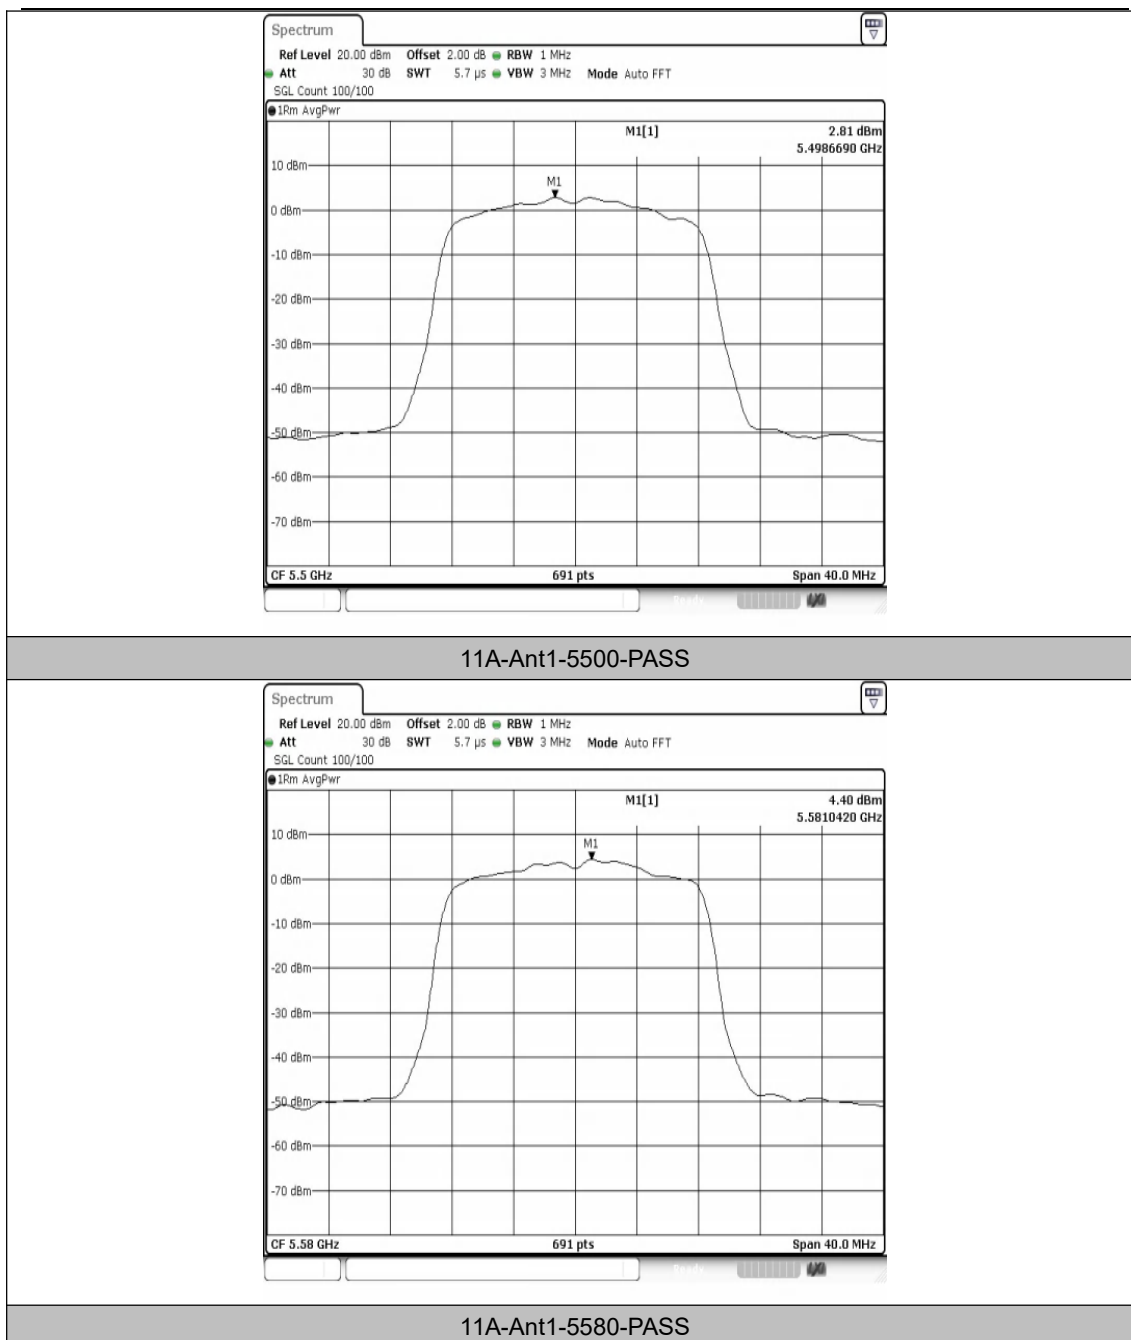

**Shenzhen Anbotek Compliance Laboratory Limited**

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

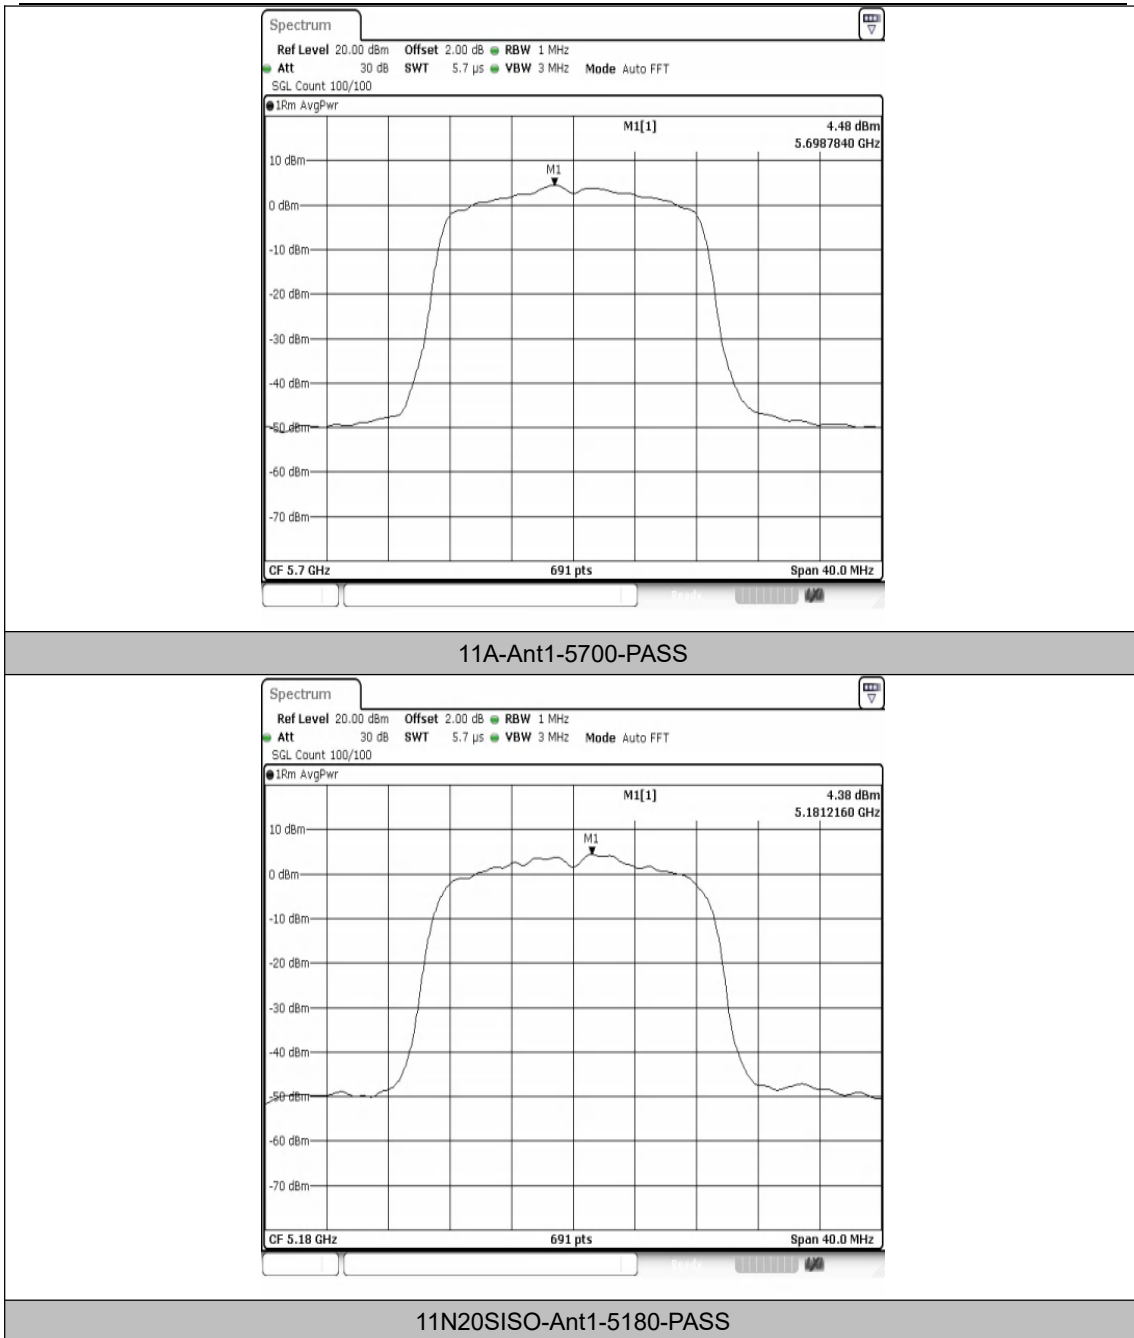

**Shenzhen Anbotek Compliance Laboratory Limited**

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

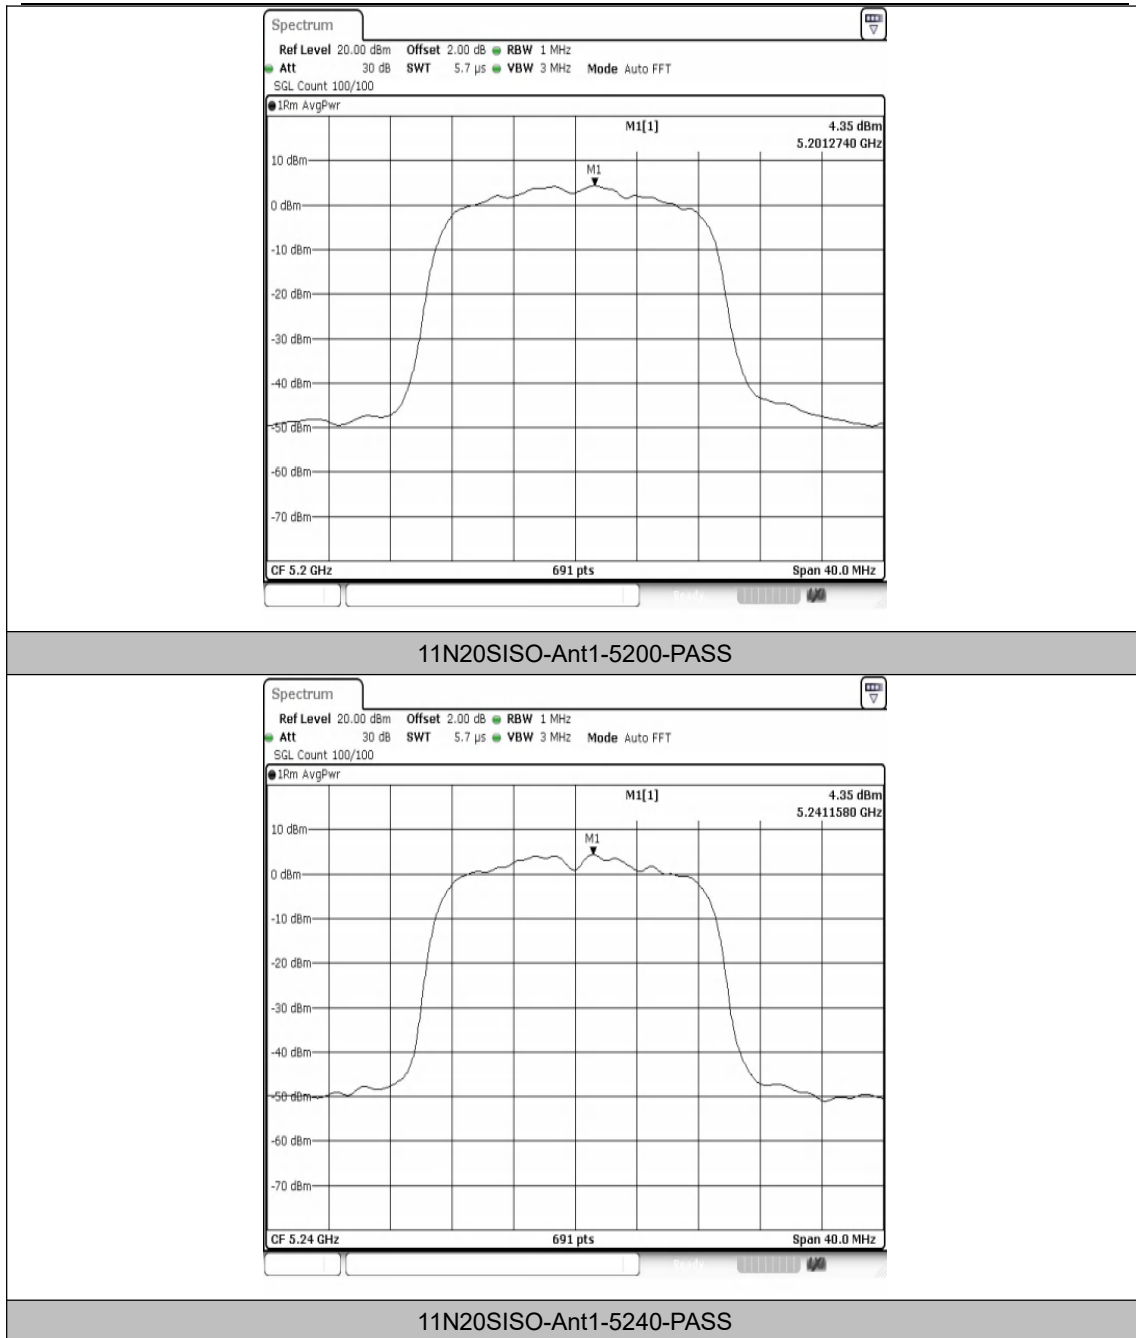


**Shenzhen Anbotek Compliance Laboratory Limited**

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

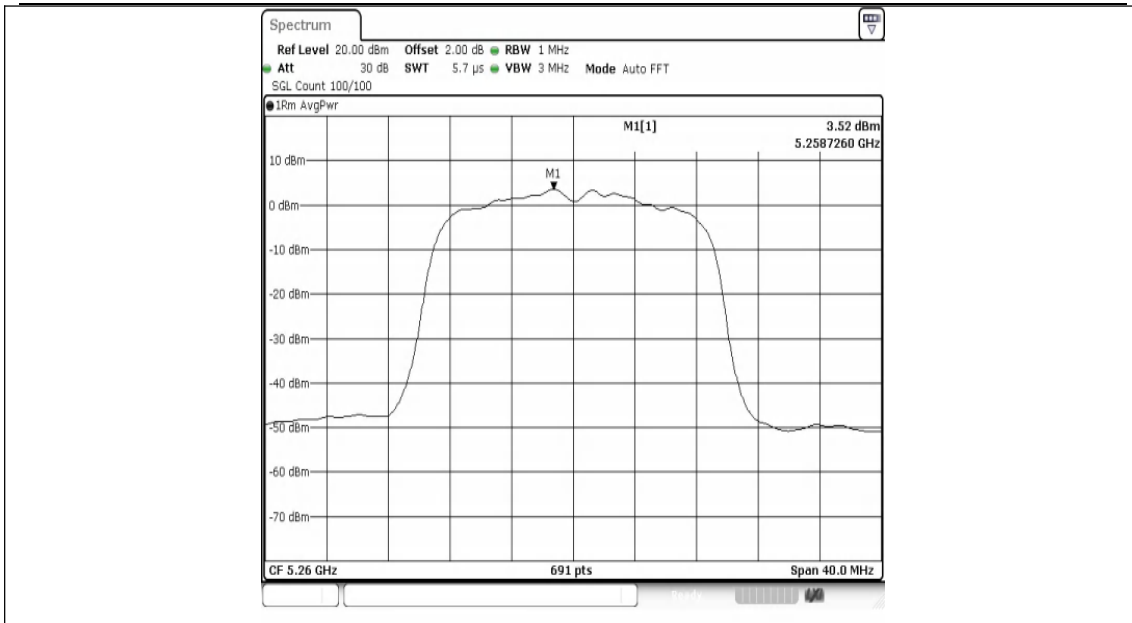

11N20SISO-Ant1-5260-PASS

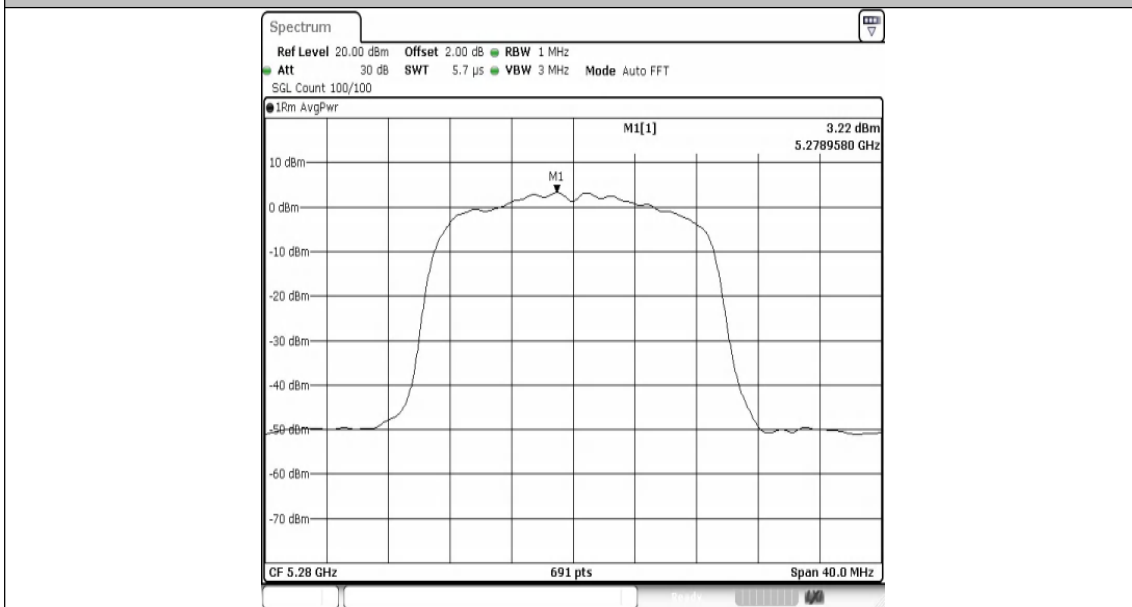


11N20SISO-Ant1-5280-PASS

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

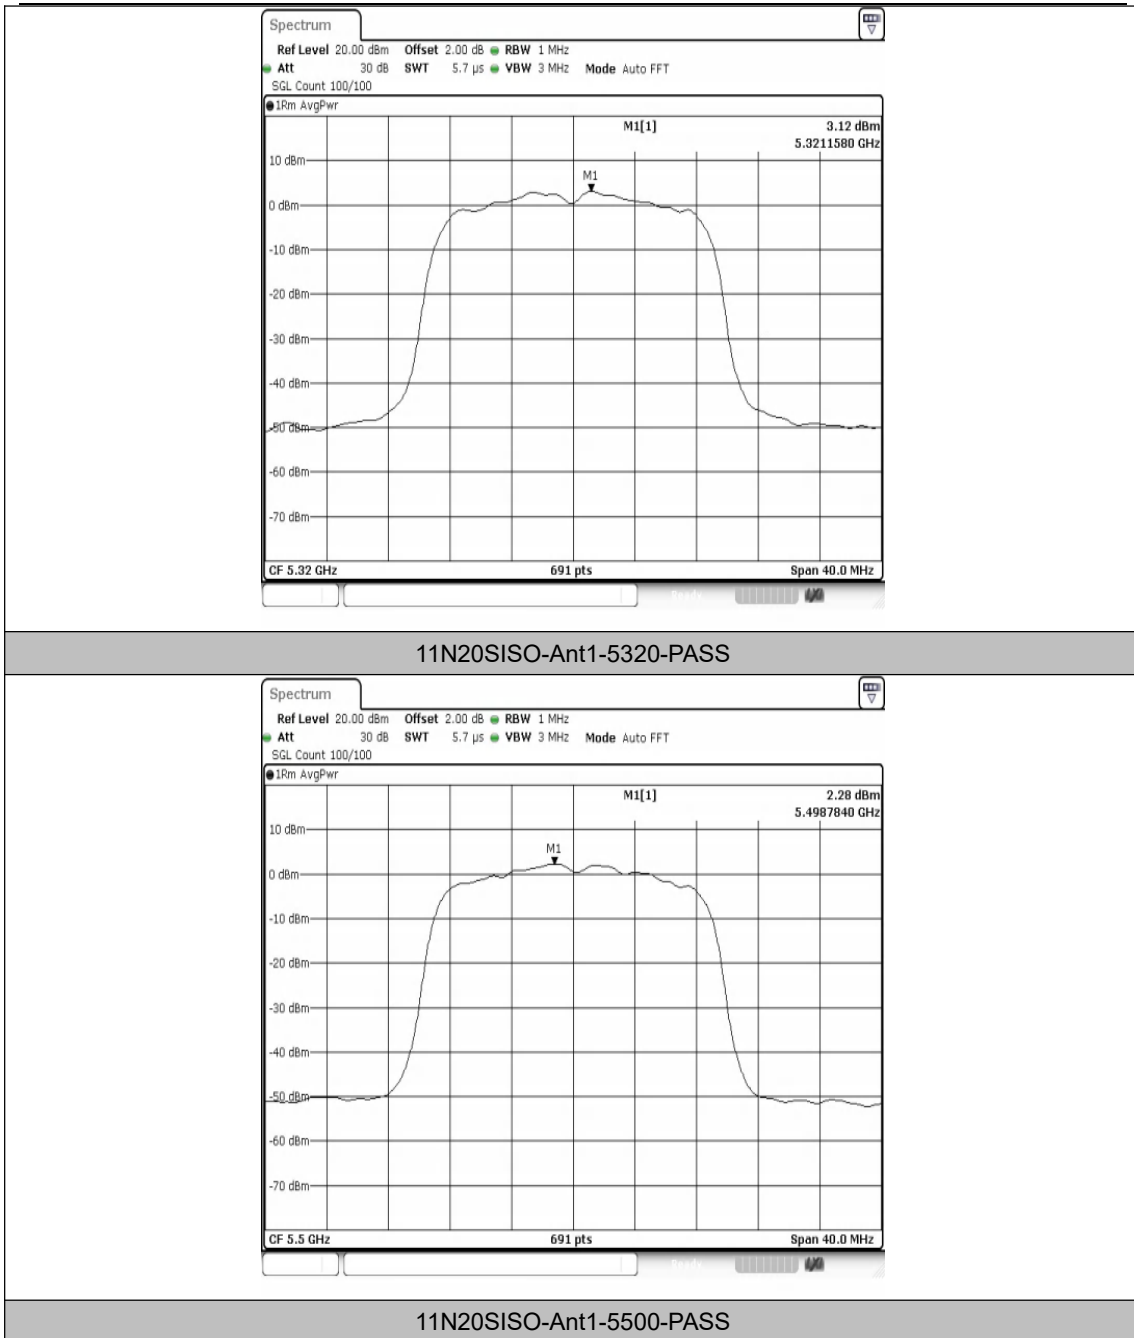

**Shenzhen Anbotek Compliance Laboratory Limited**

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

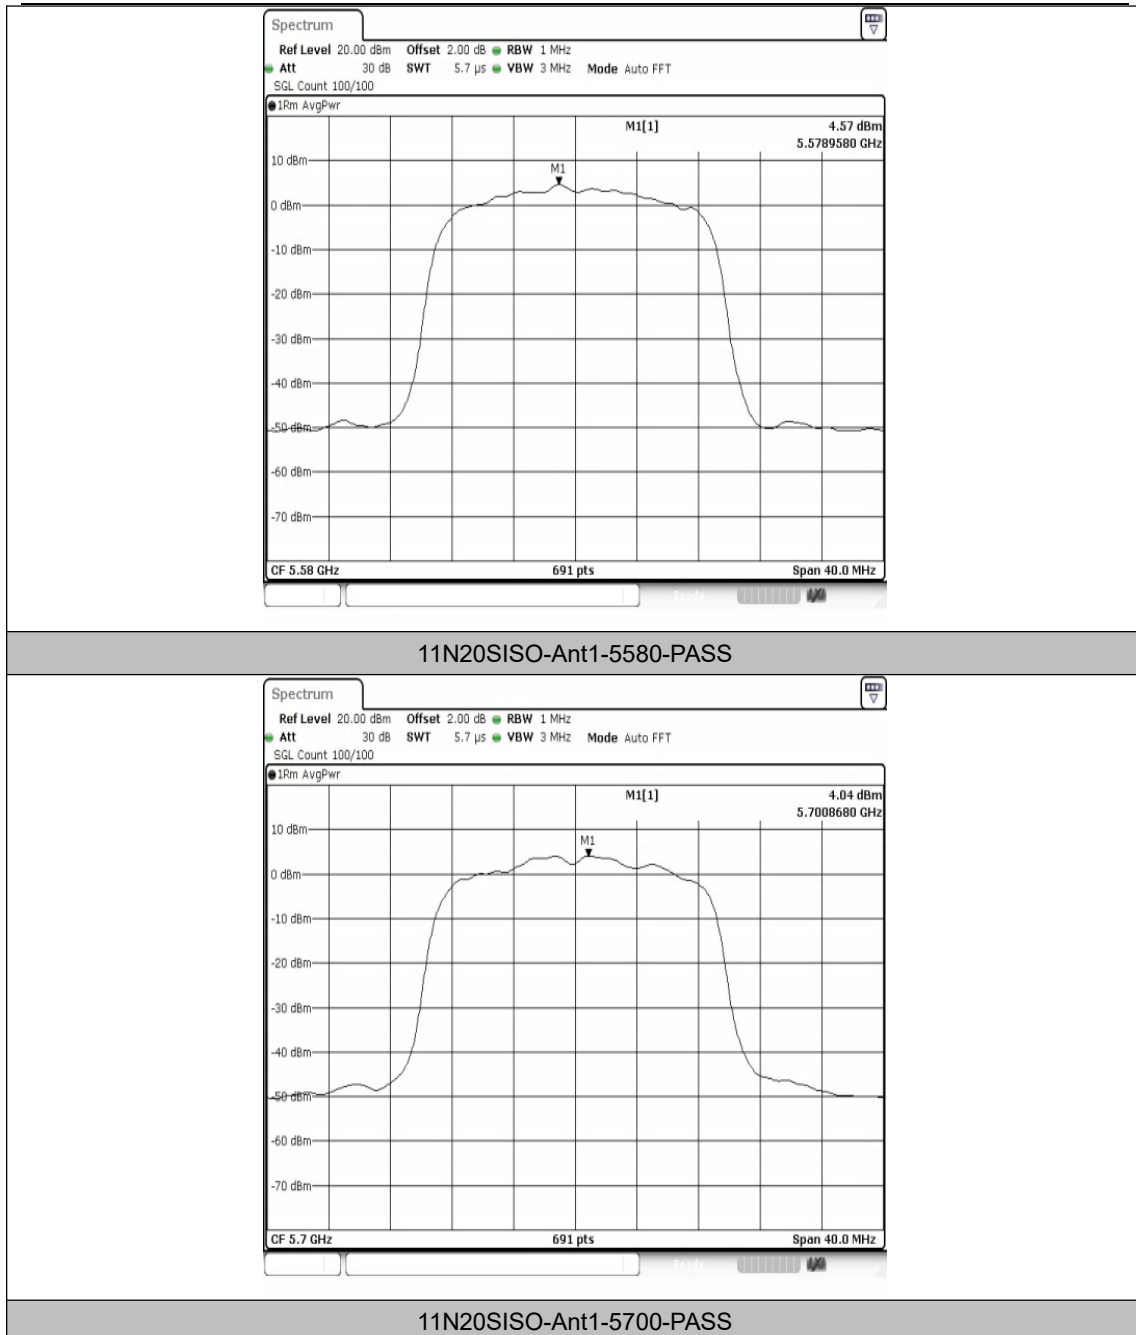


### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

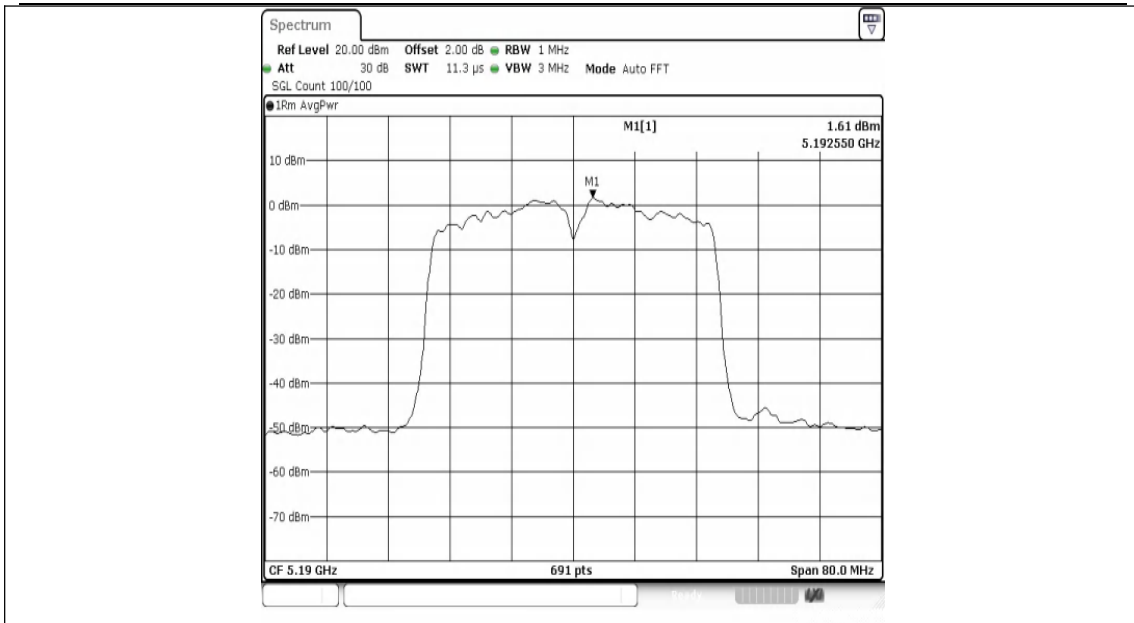

11N40SISO-Ant1-5190-PASS

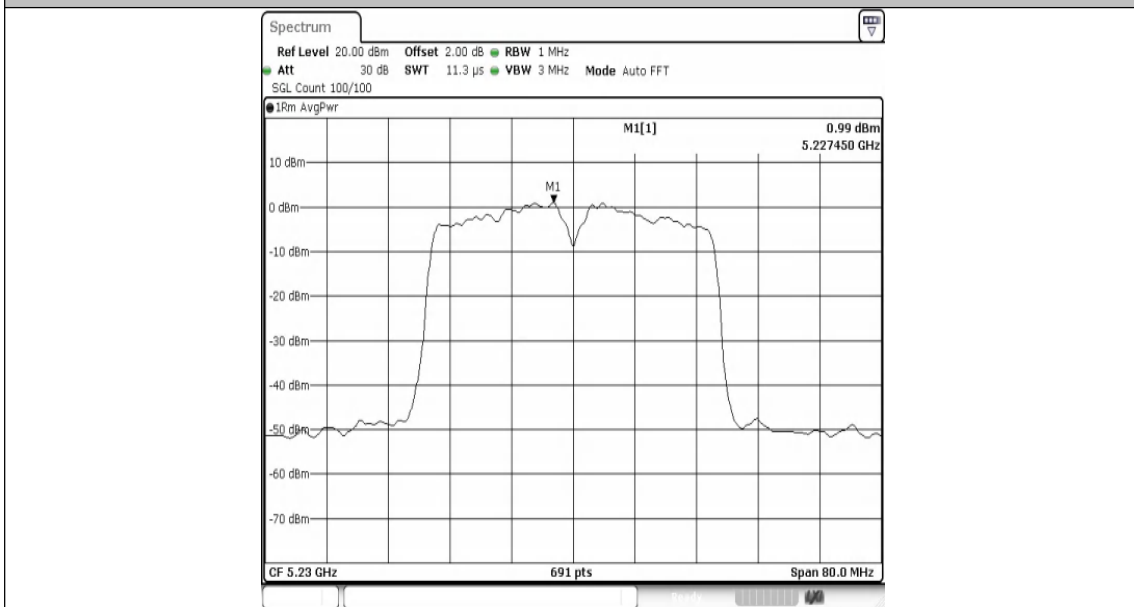


11N40SISO-Ant1-5230-PASS

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

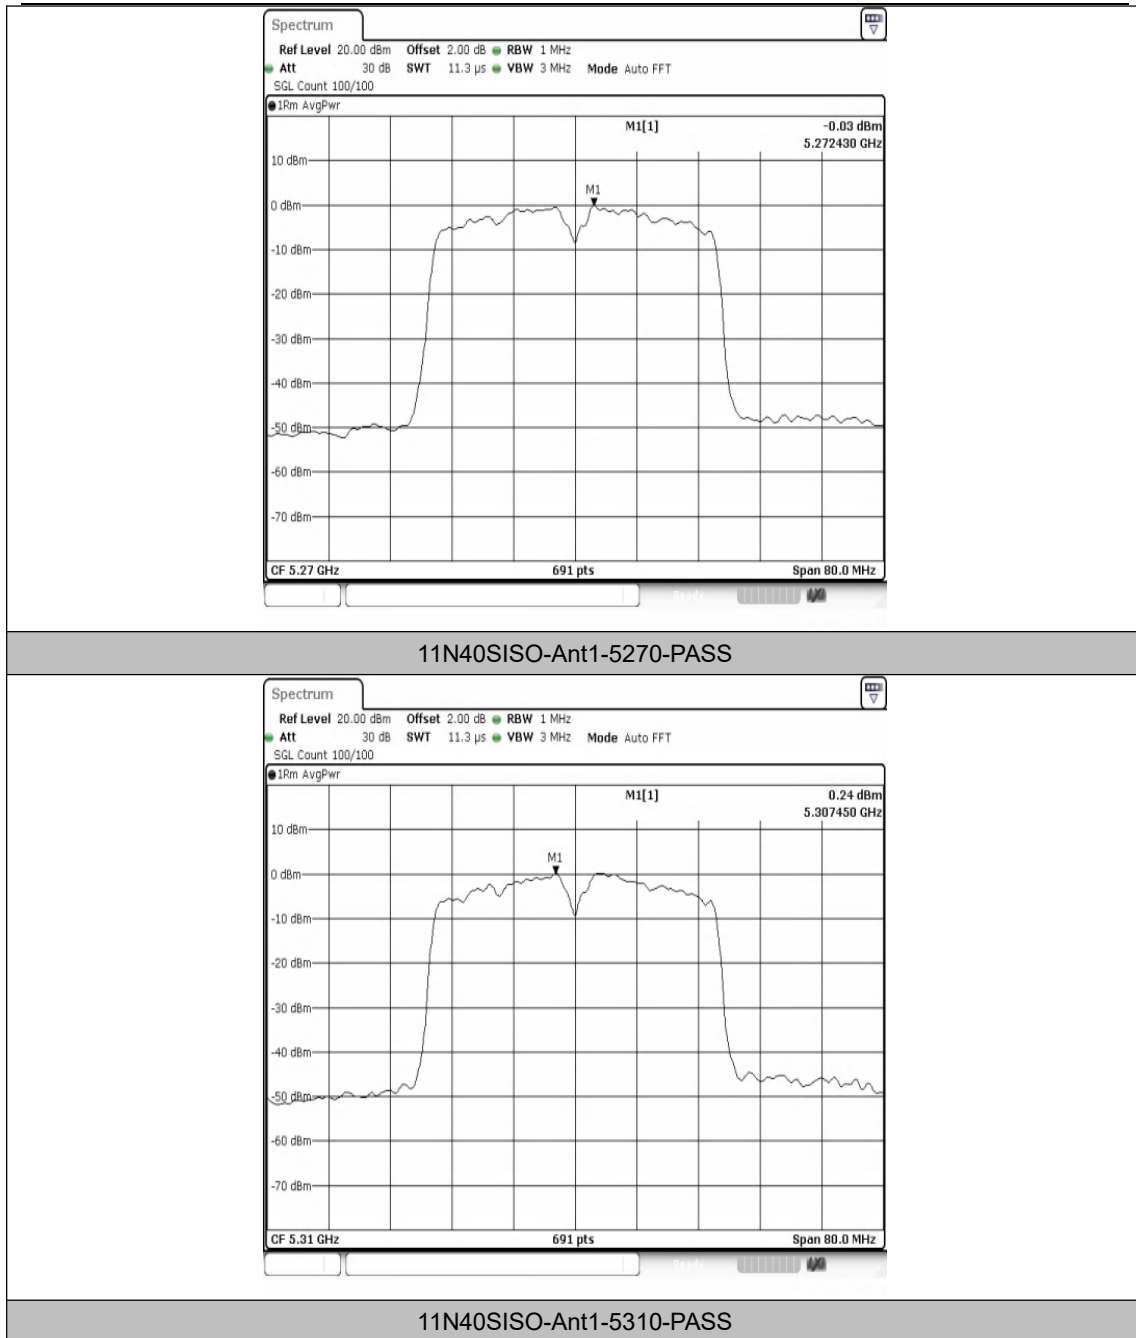

**Shenzhen Anbotek Compliance Laboratory Limited**

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

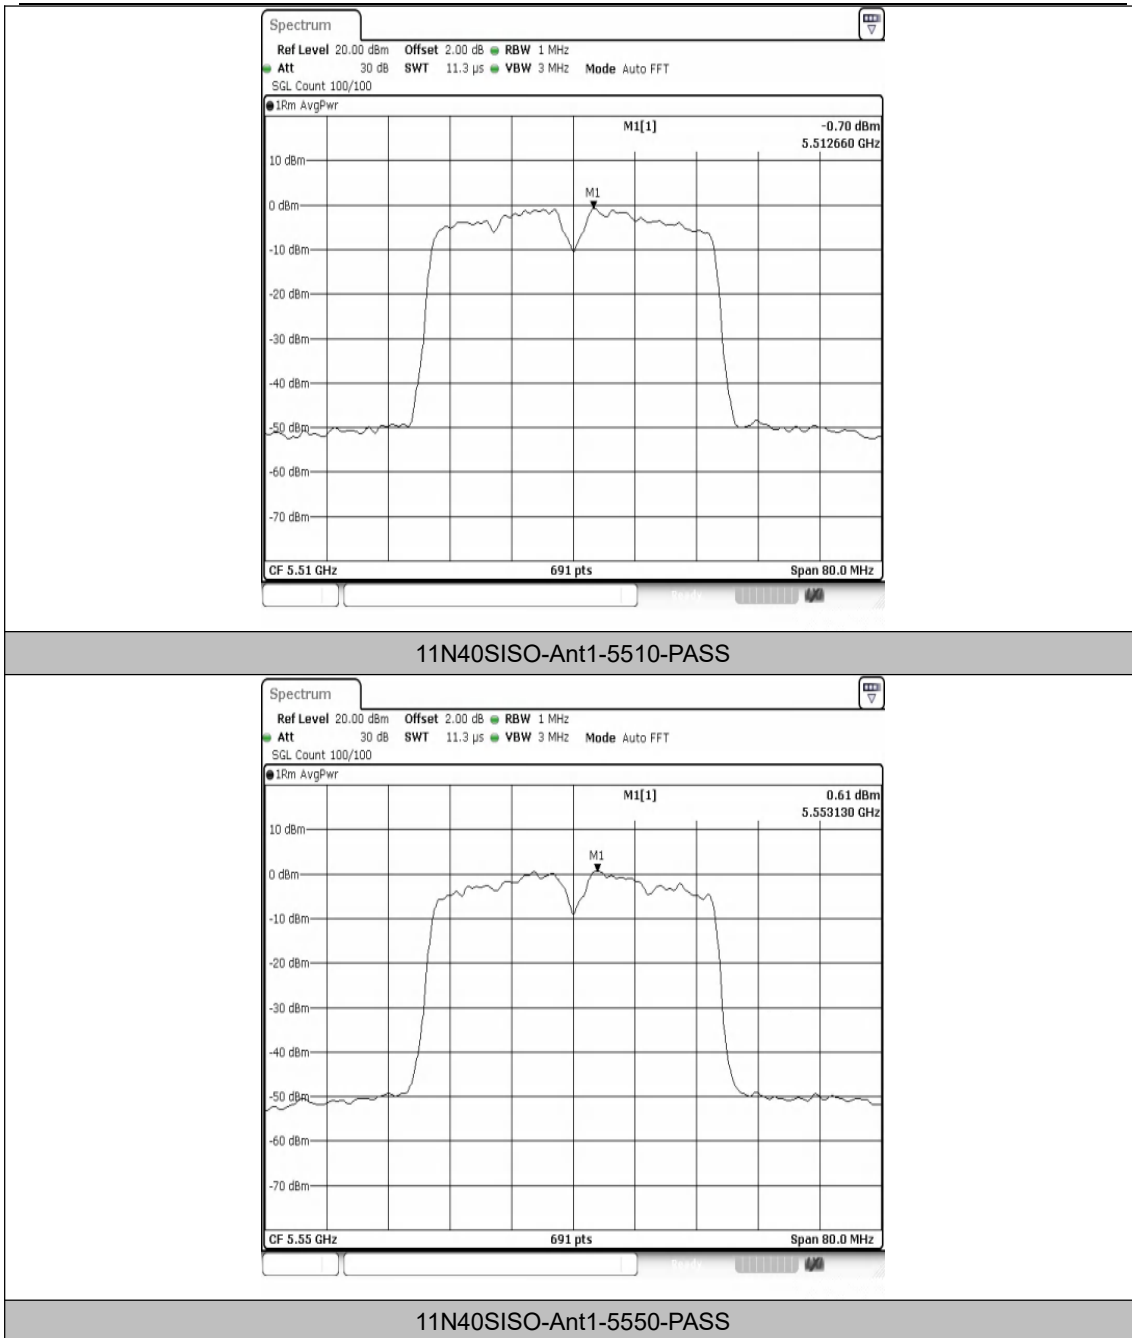


#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

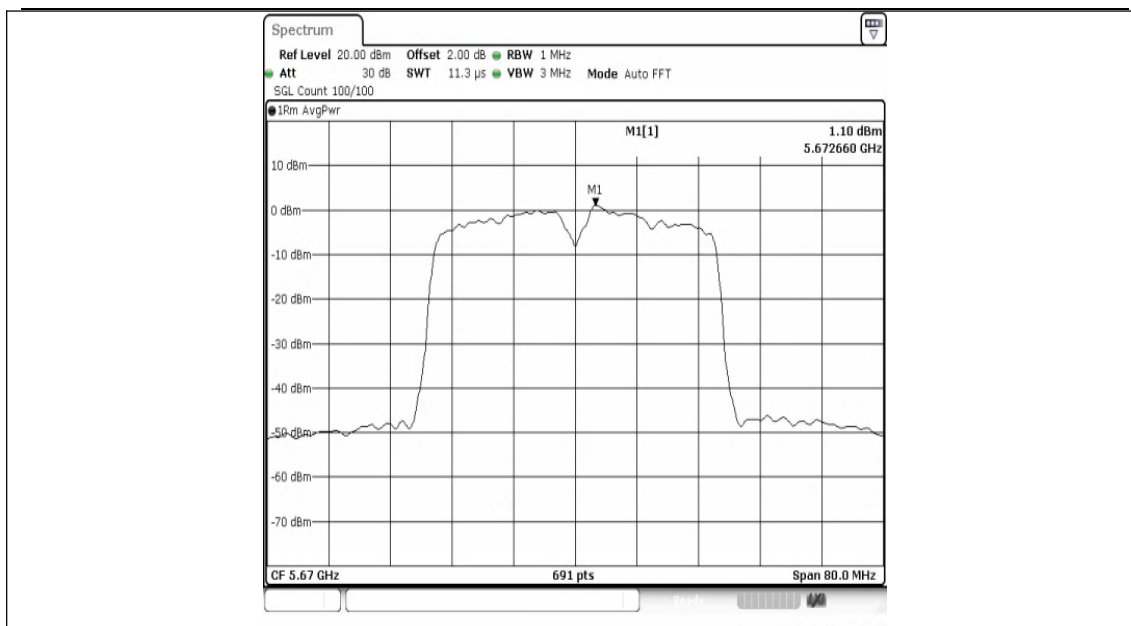

11N40SISO-Ant1-5670-PASS

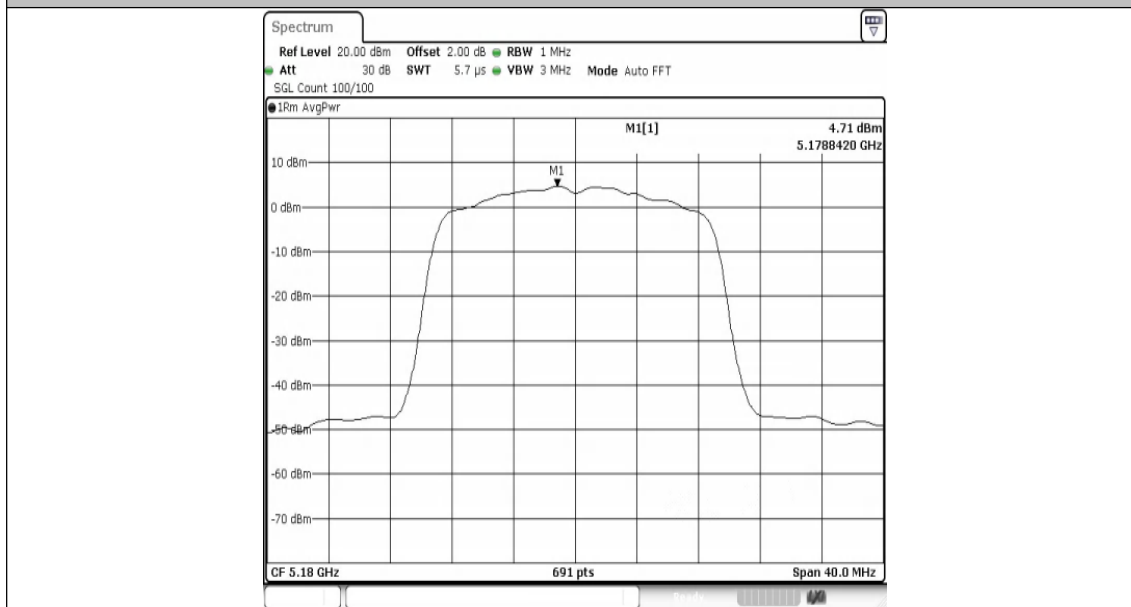


11AC20SISO-Ant1-5180-PASS

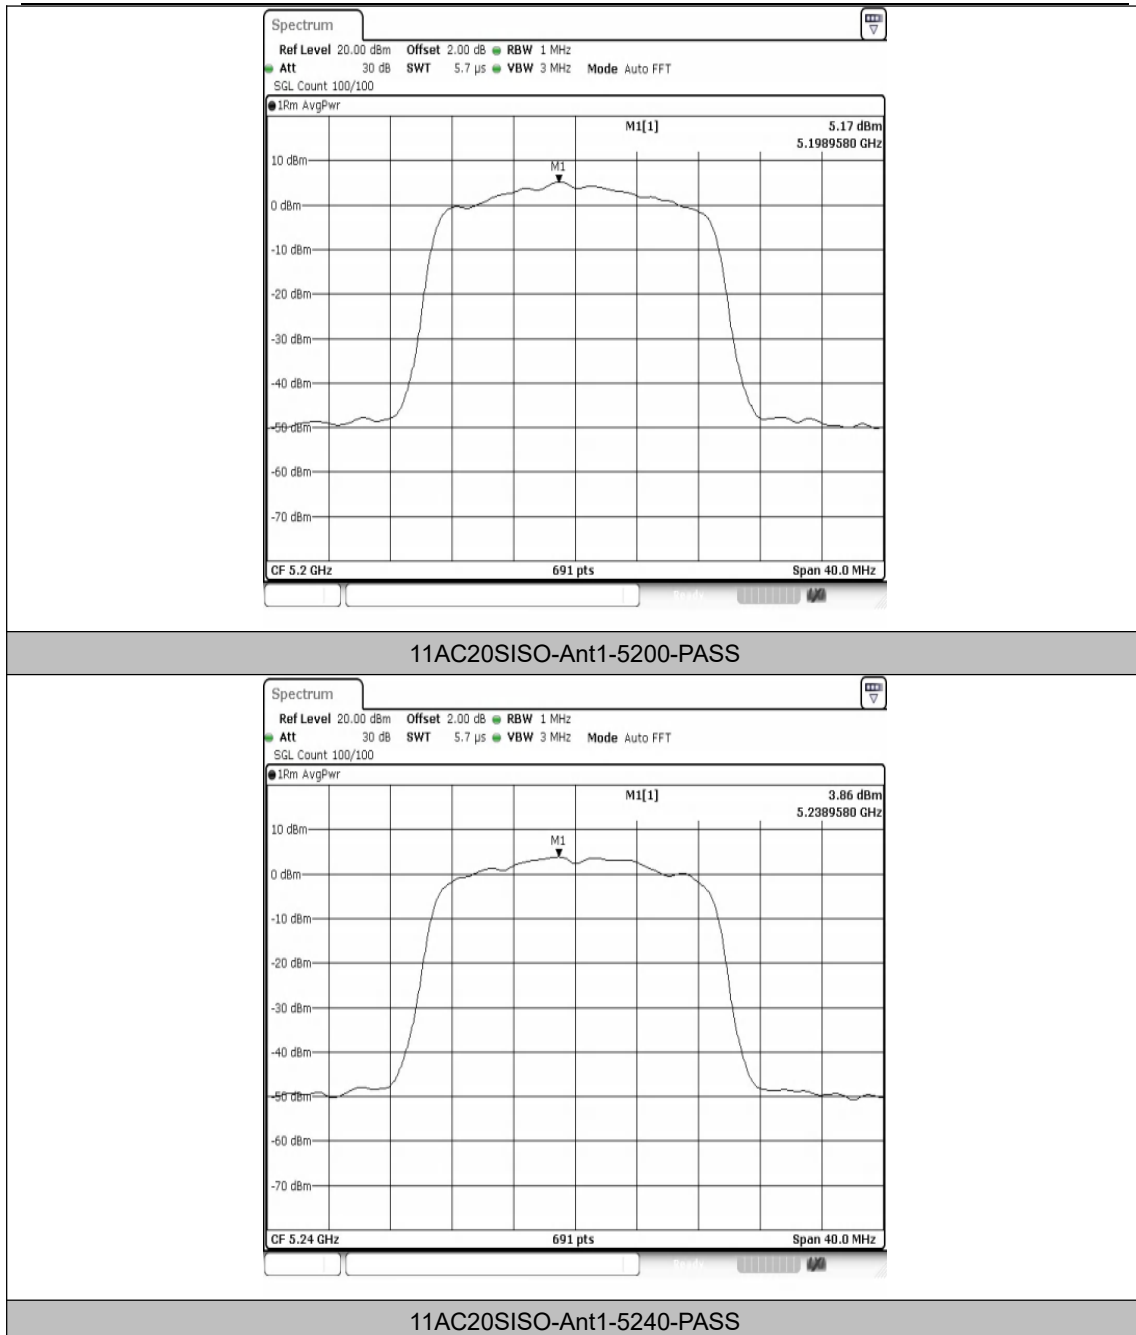


### Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

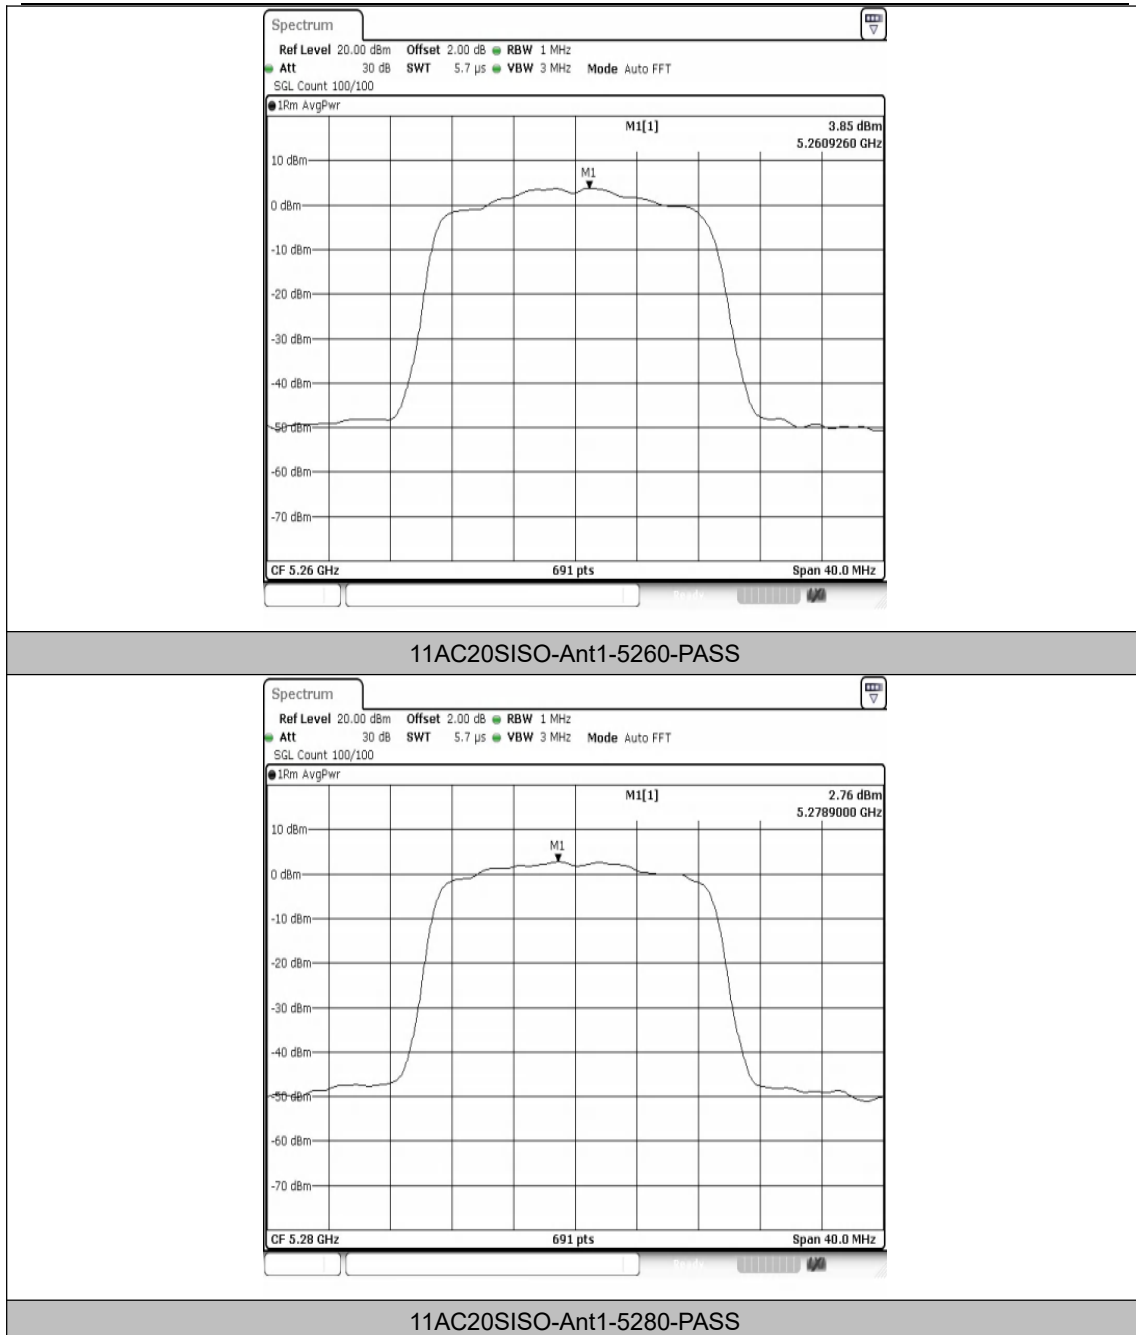


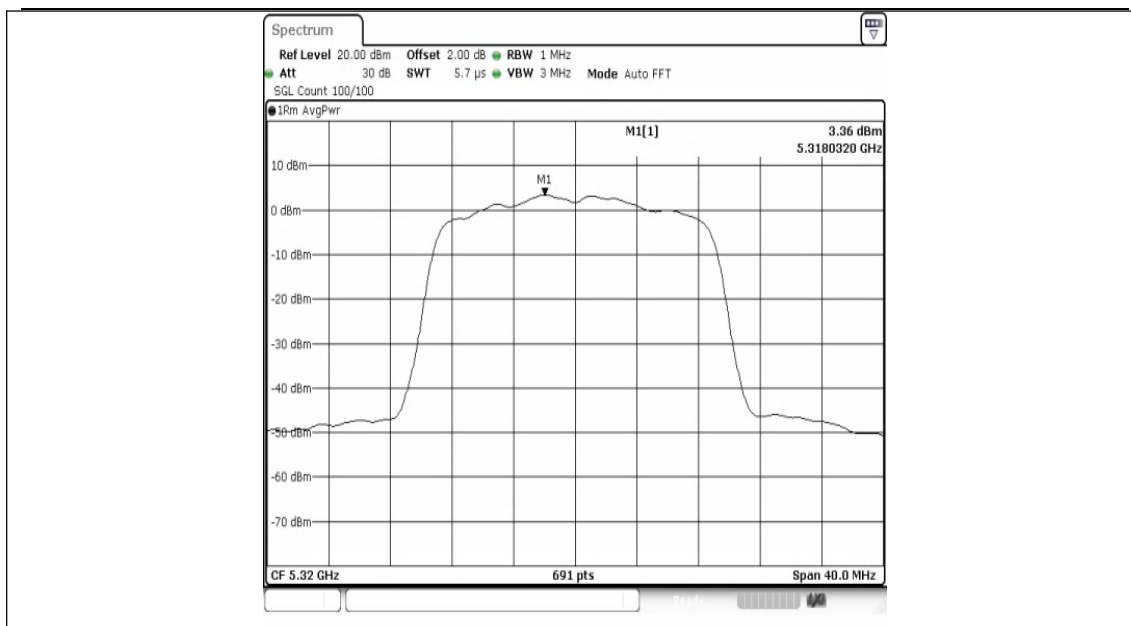

11AC20SISO-Ant1-5320-PASS

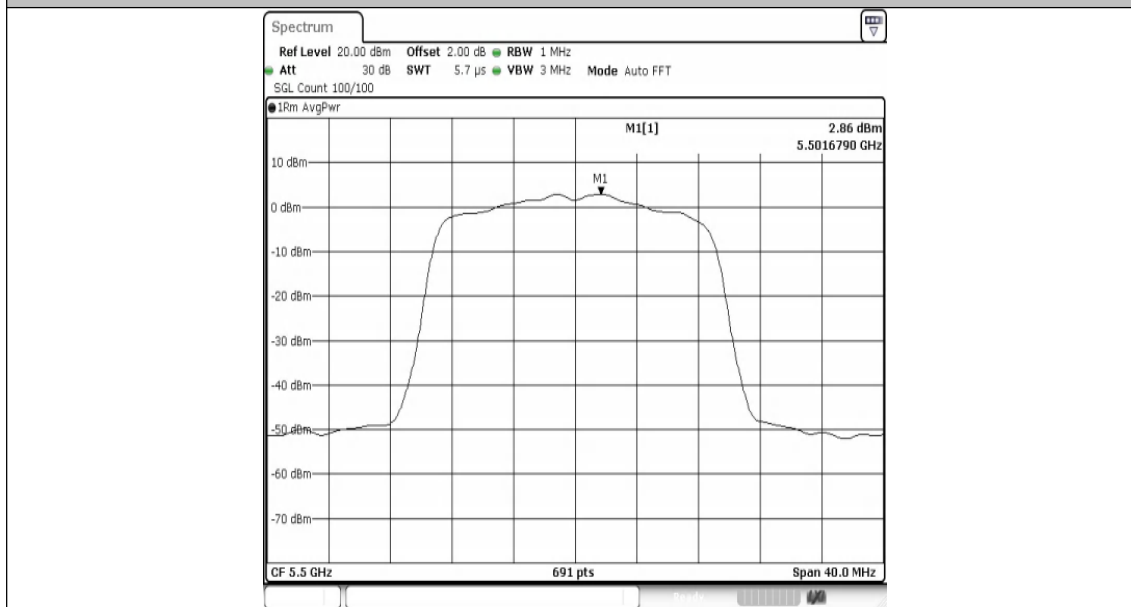


11AC20SISO-Ant1-5500-PASS

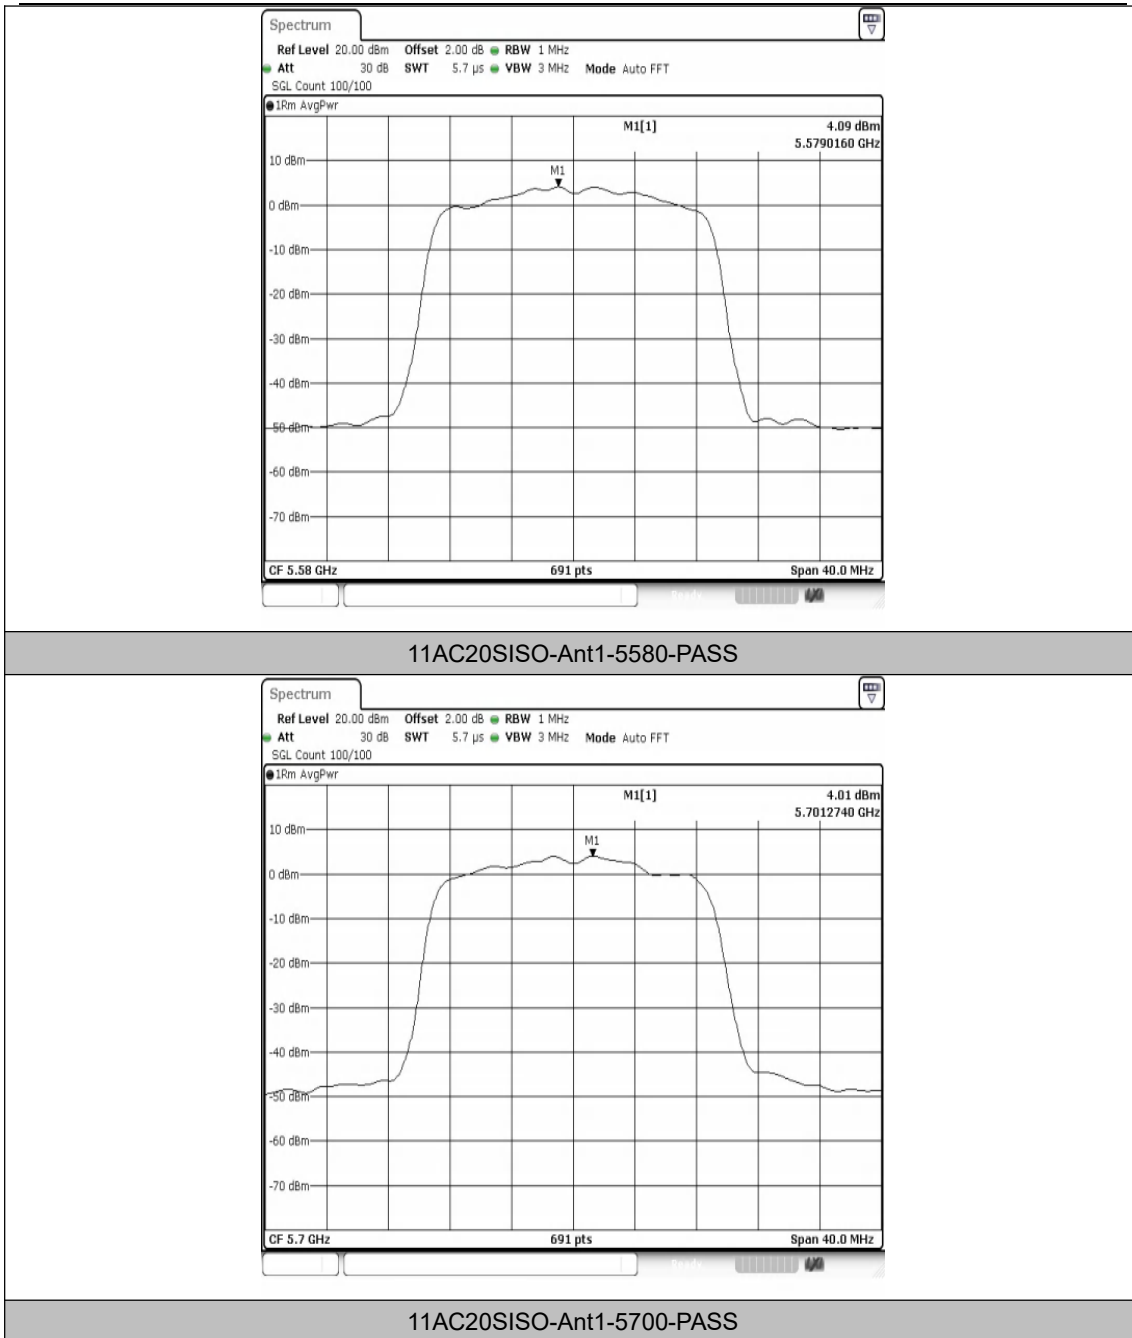


**Shenzhen Anbotek Compliance Laboratory Limited**

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

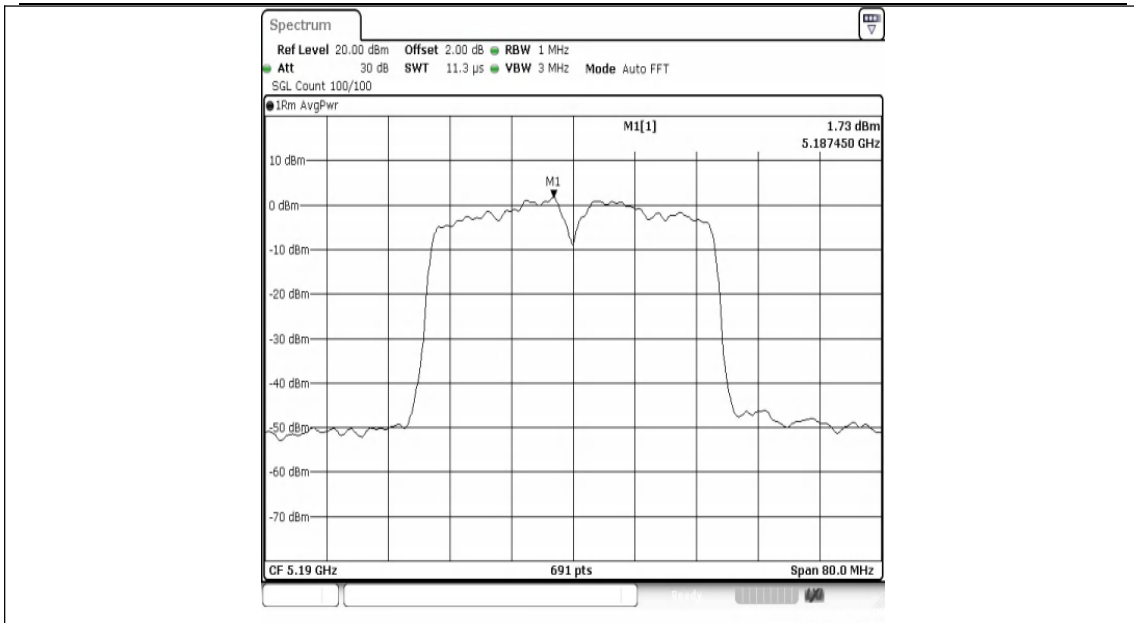

11AC40SISO-Ant1-5190-PASS

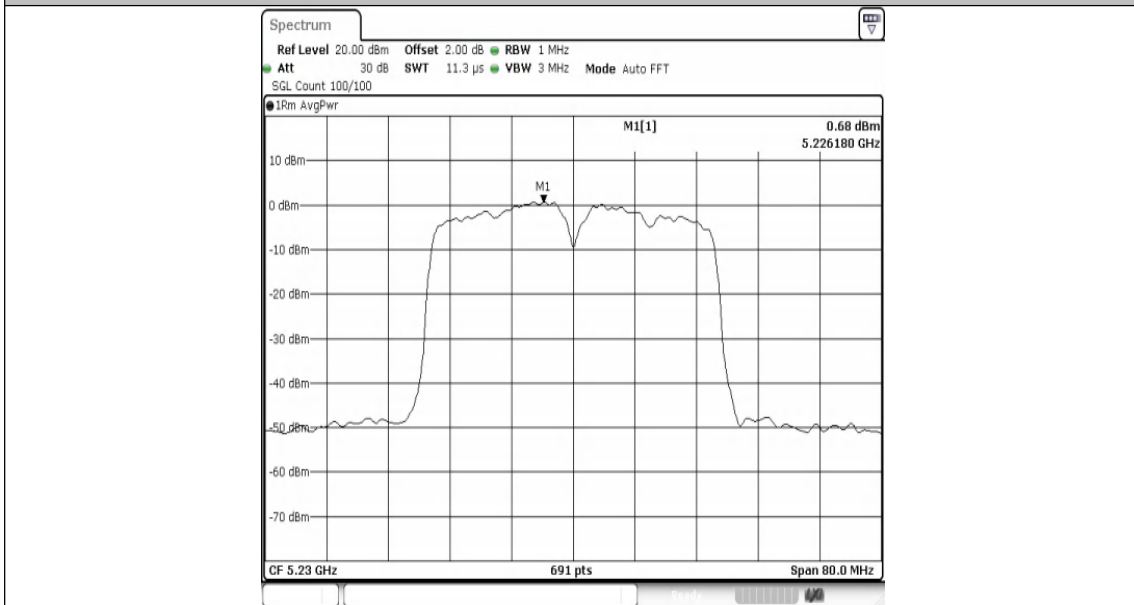


11AC40SISO-Ant1-5230-PASS


### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

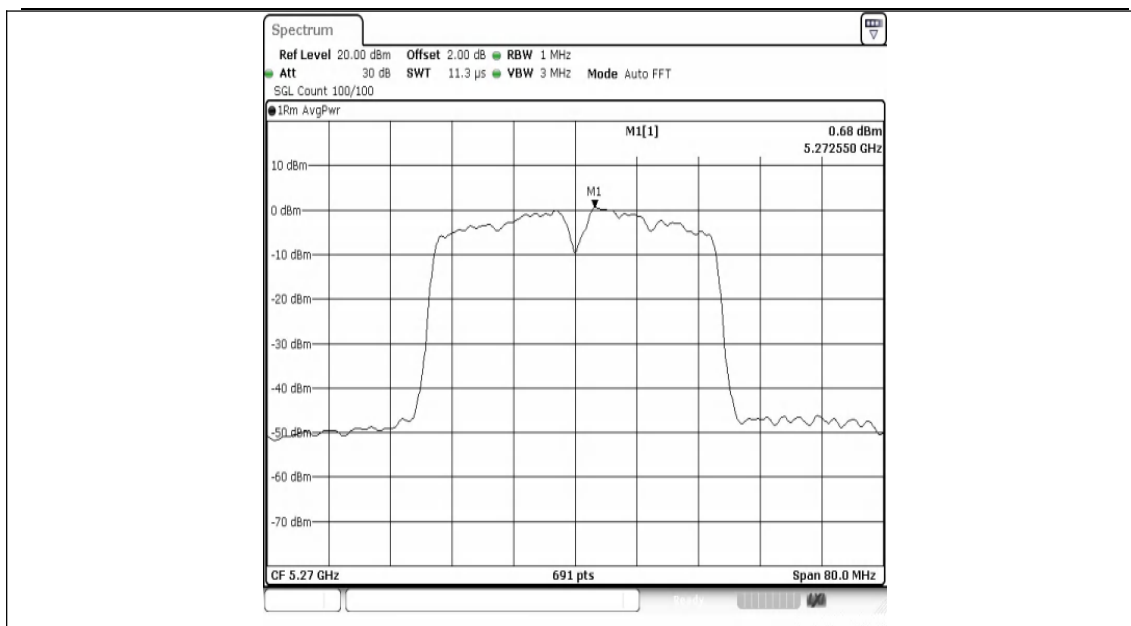


11AC40SISO-Ant1-5270-PASS

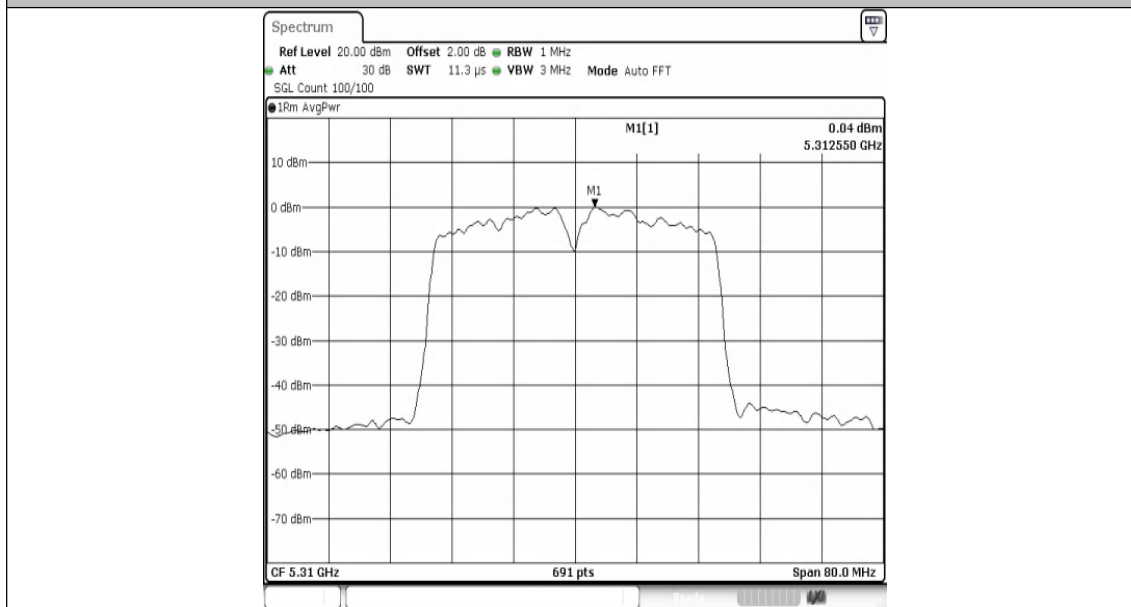


11AC40SISO-Ant1-5310-PASS

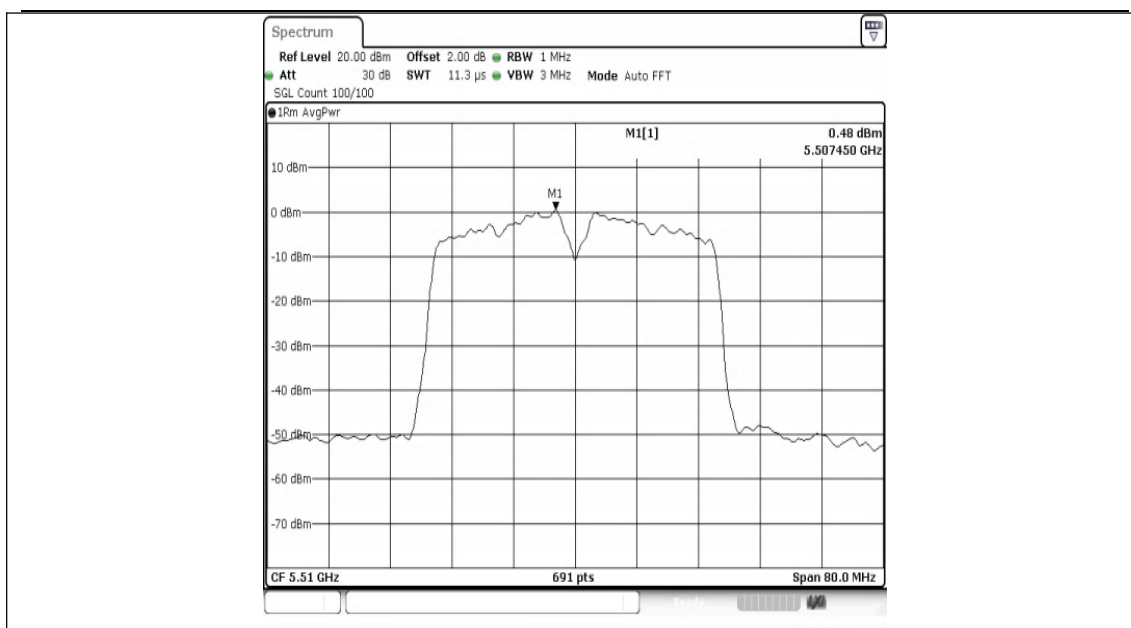


11AC40SISO-Ant1-5510-PASS

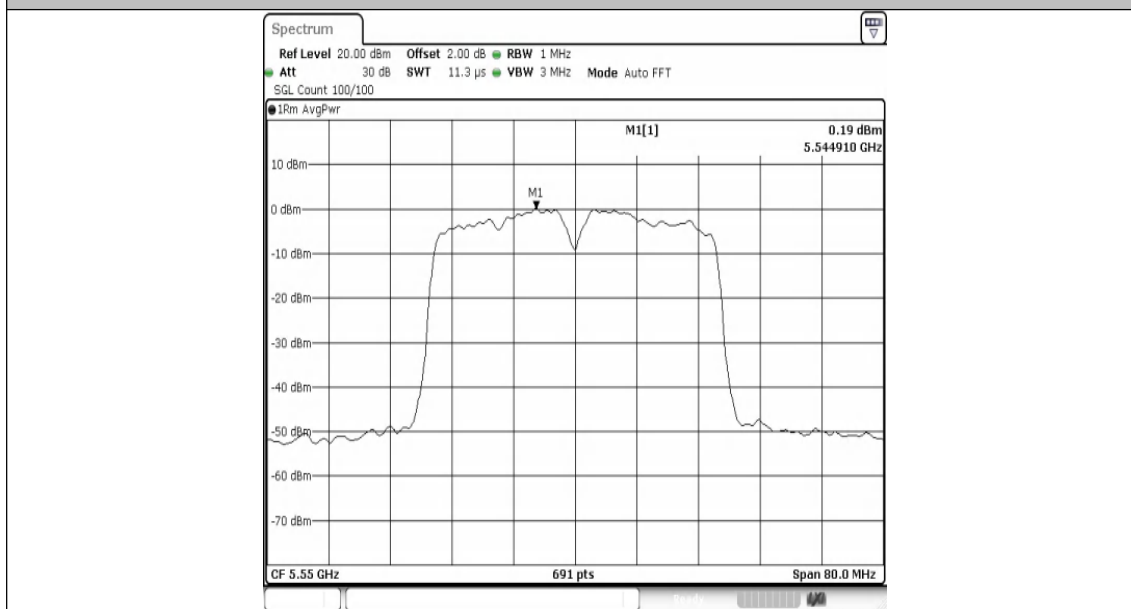


11AC40SISO-Ant1-5550-PASS

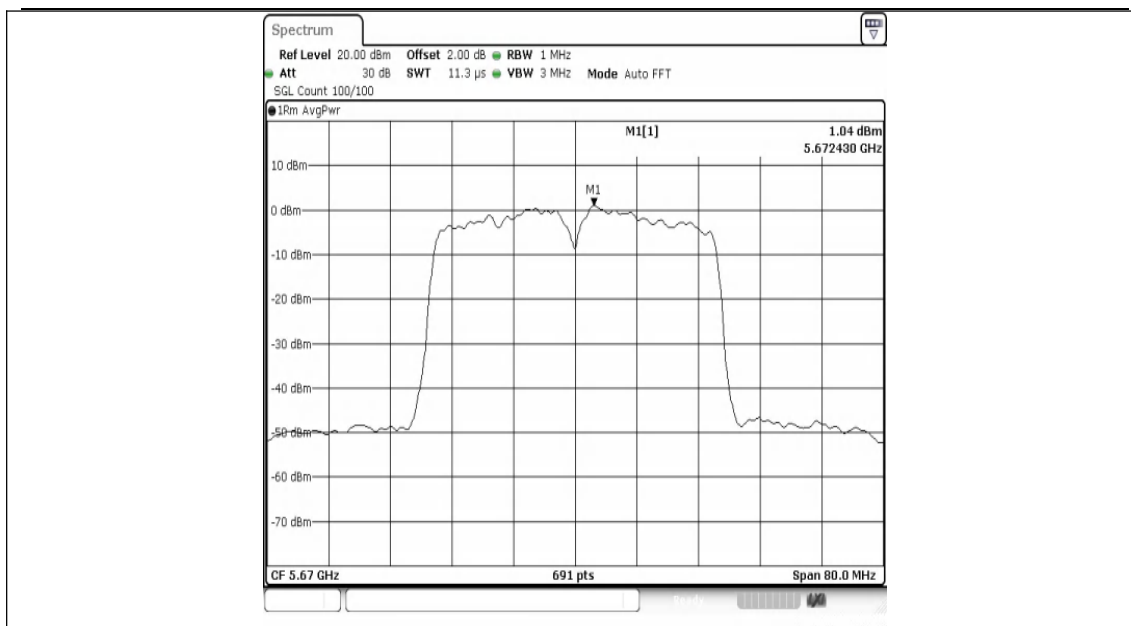

11AC40SISO-Ant1-5670-PASS

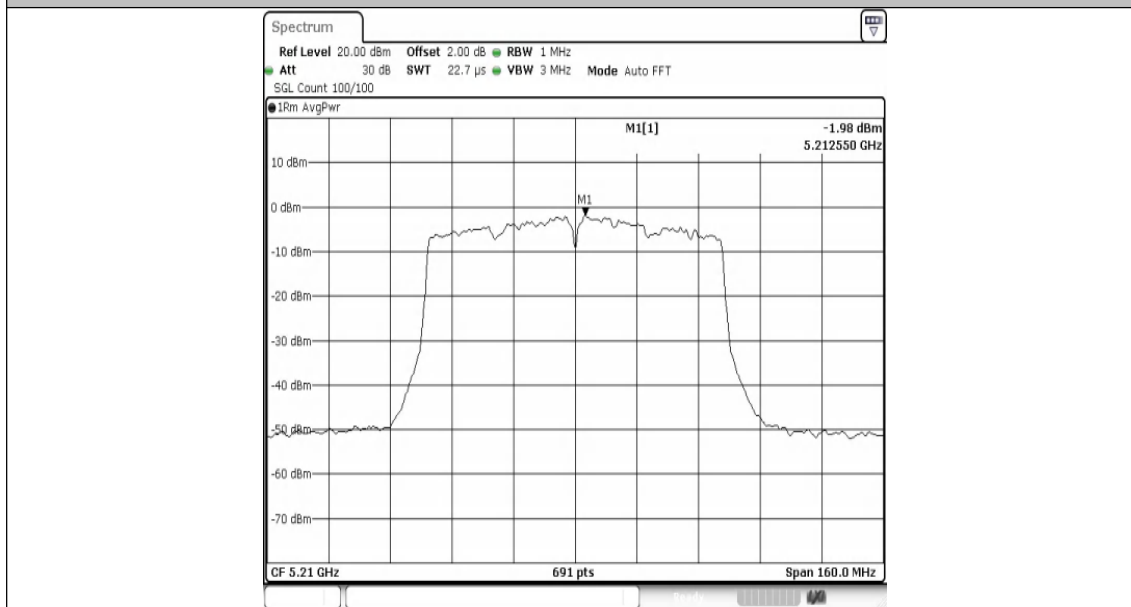


11AC80SISO-Ant1-5210-PASS

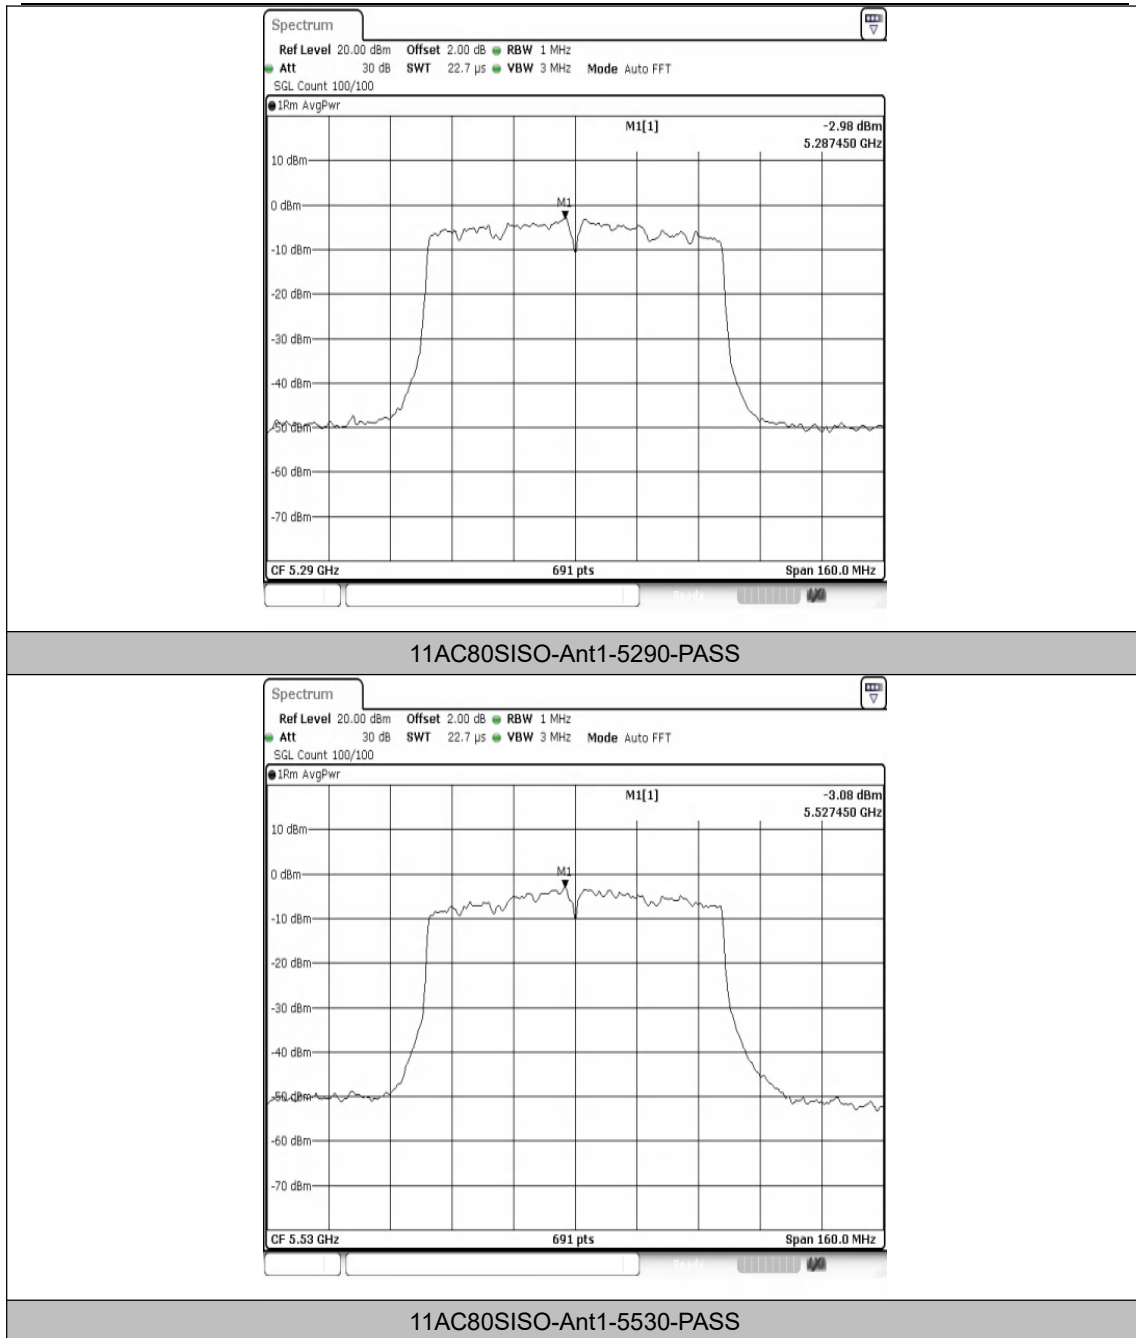


**Shenzhen Anbotek Compliance Laboratory Limited**


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

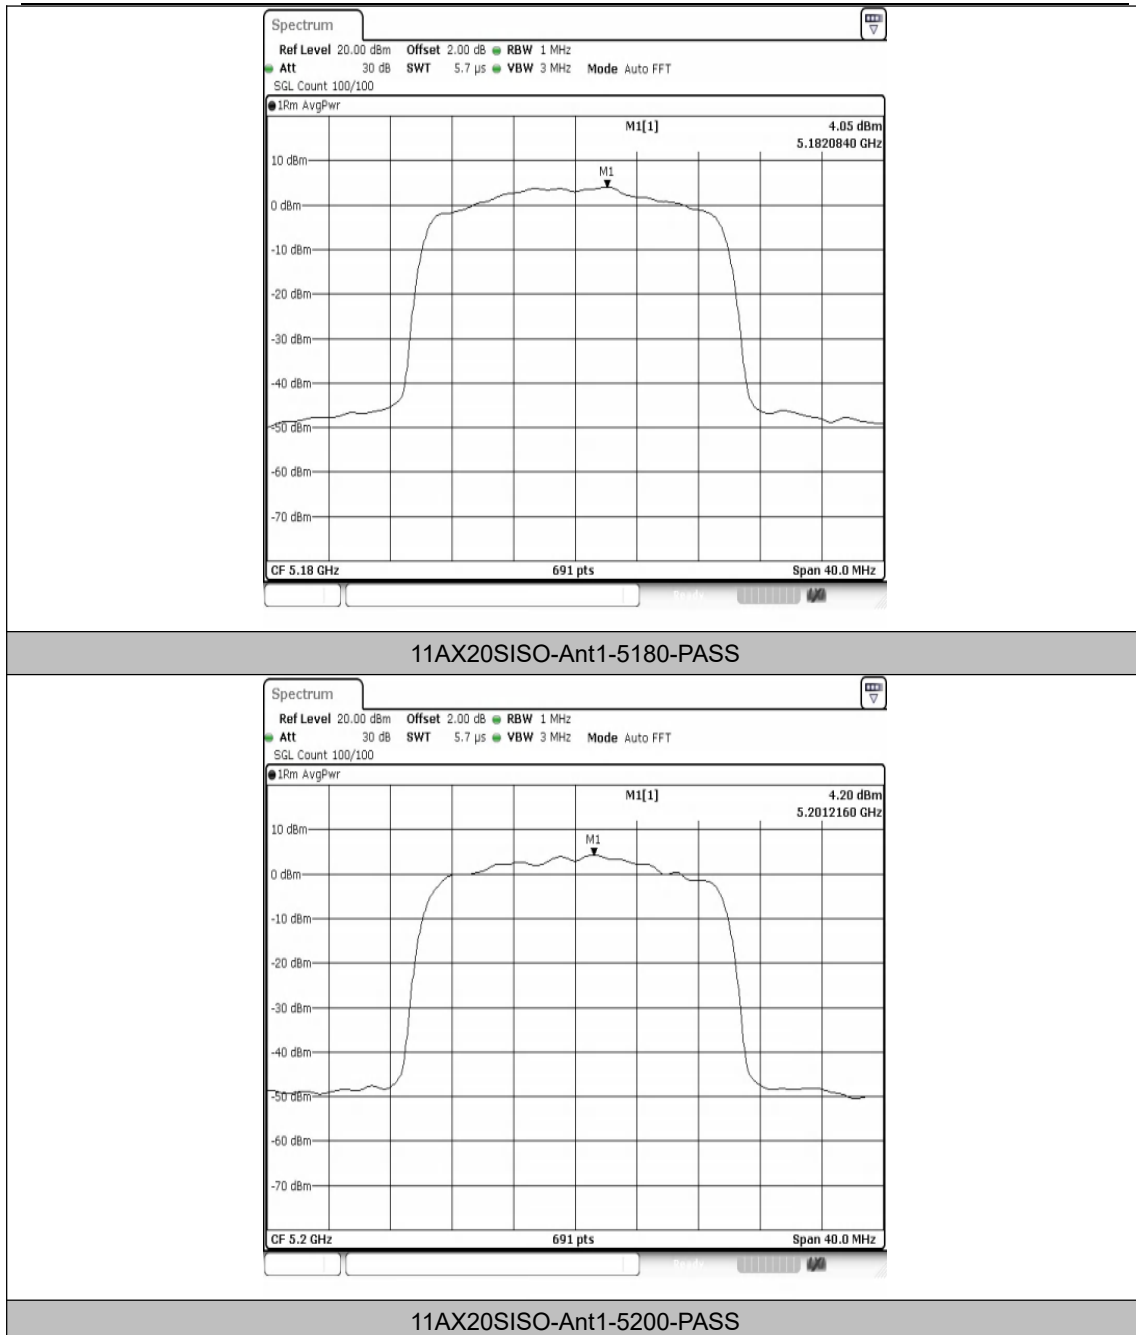


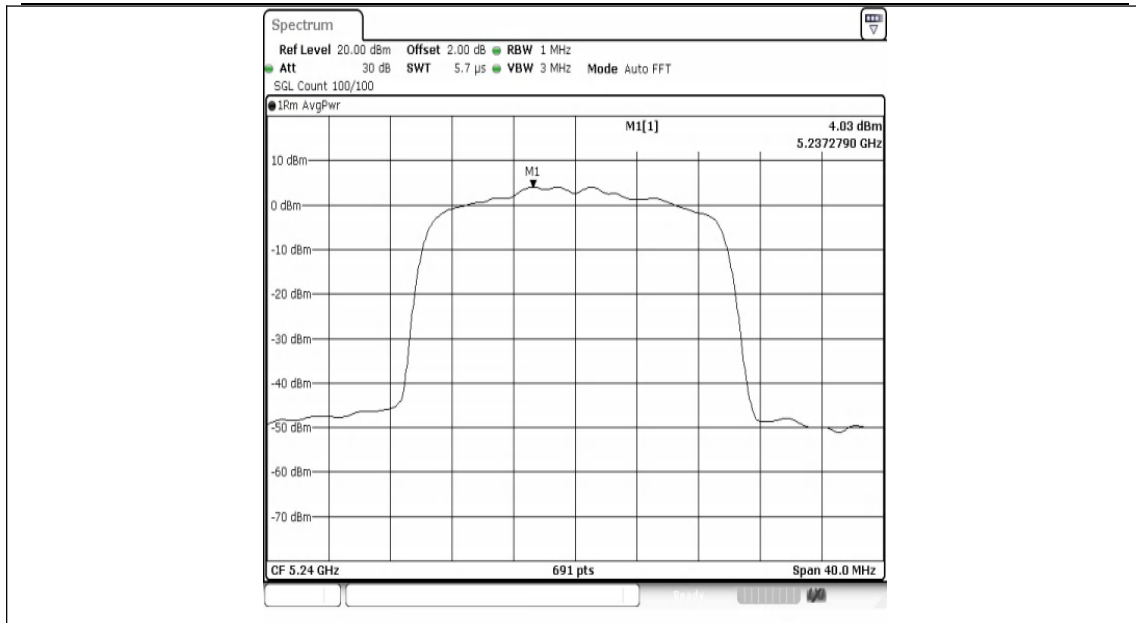


11AX20SISO-Ant1-5240-PASS

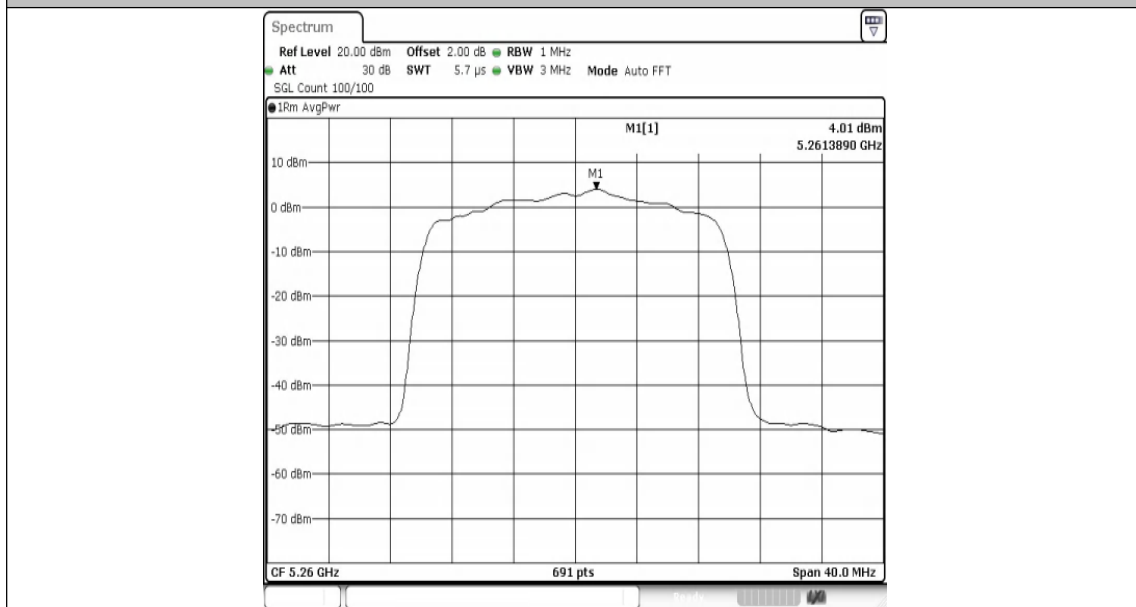

11AX20SISO-Ant1-5260-PASS

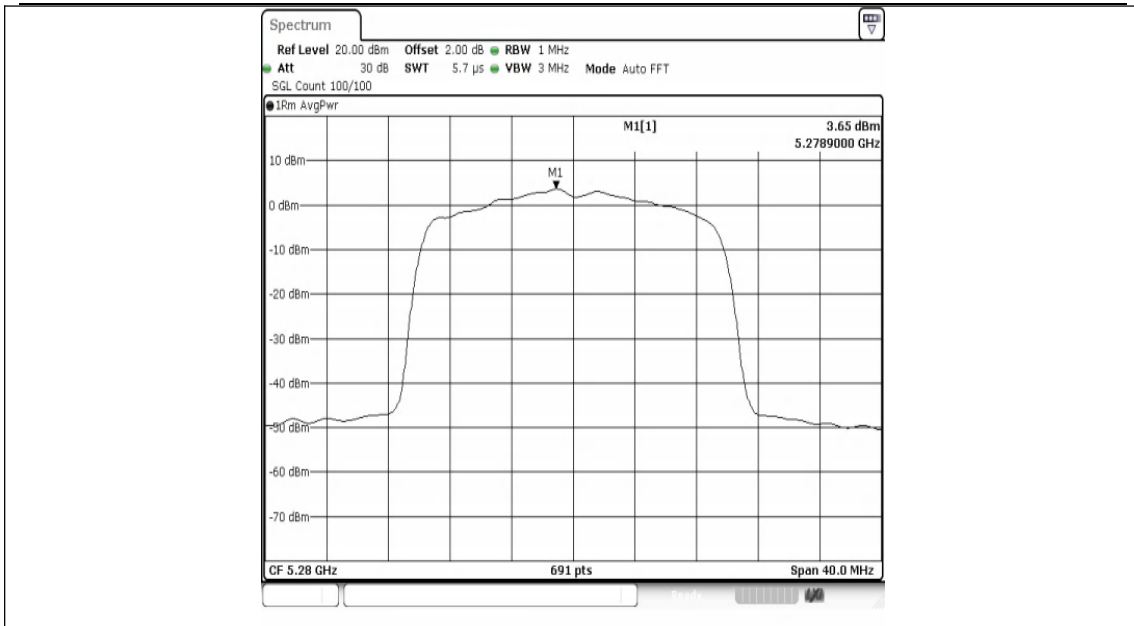

11AX20SISO-Ant1-5280-PASS

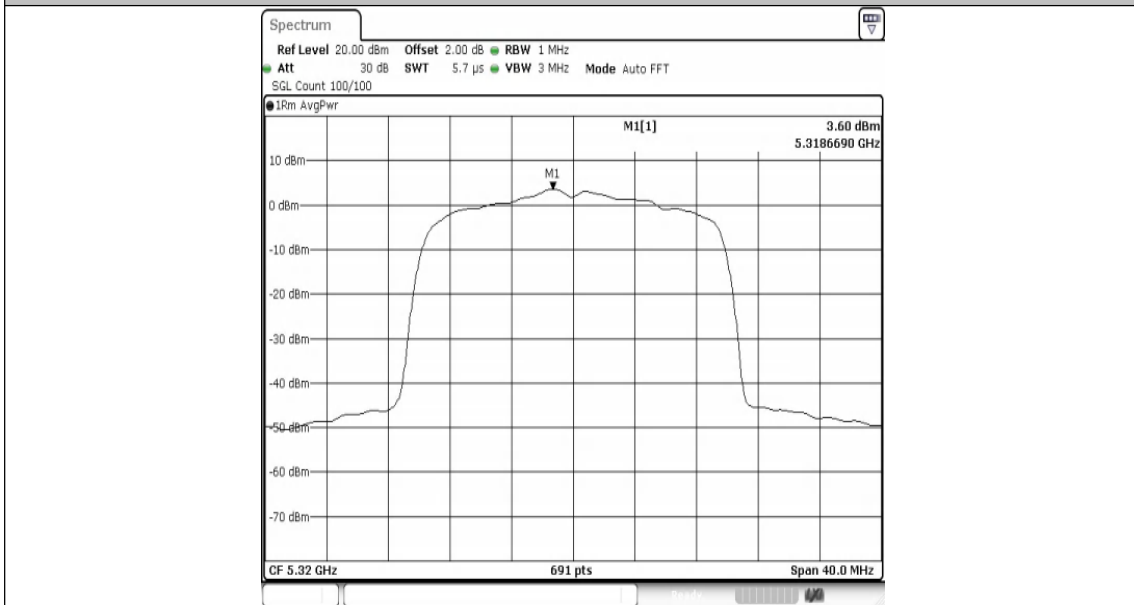


11AX20SISO-Ant1-5320-PASS


### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

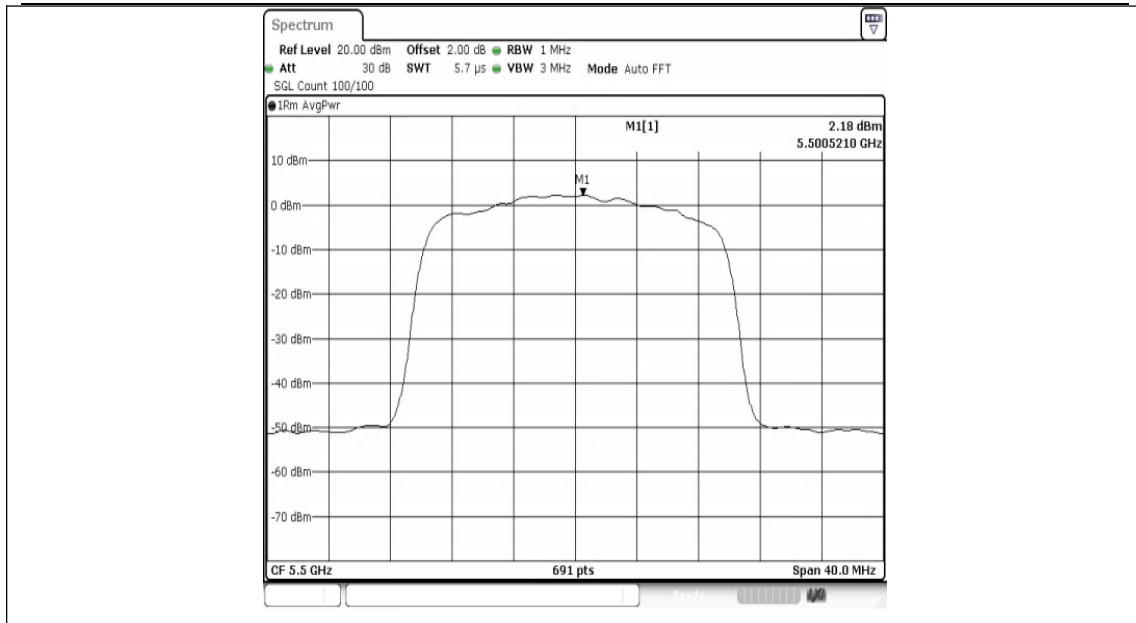


11AX20SISO-Ant1-5500-PASS

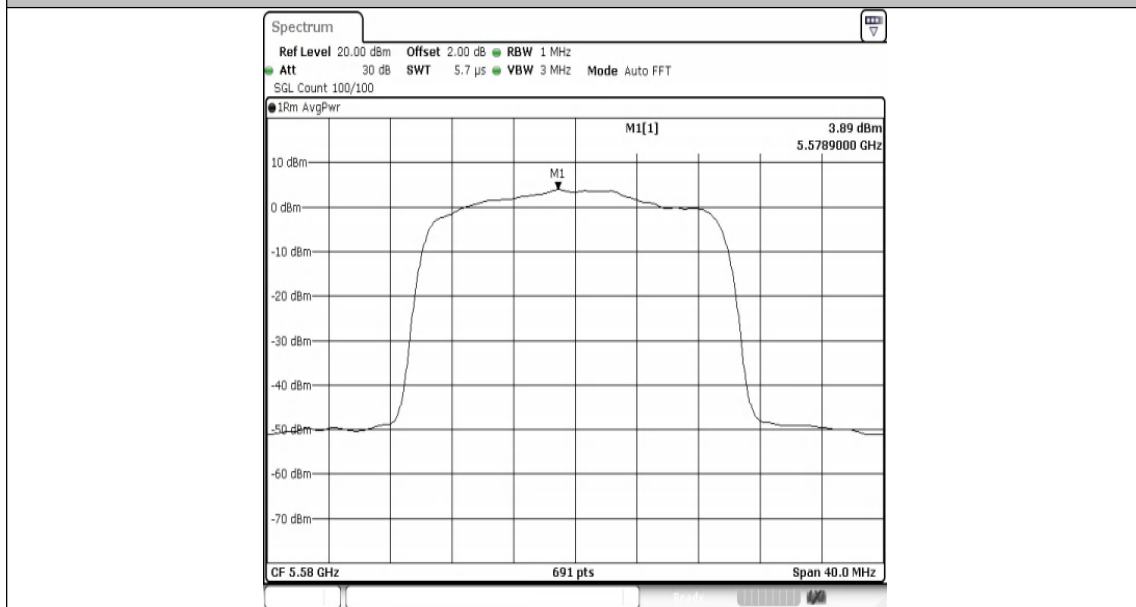


11AX20SISO-Ant1-5580-PASS

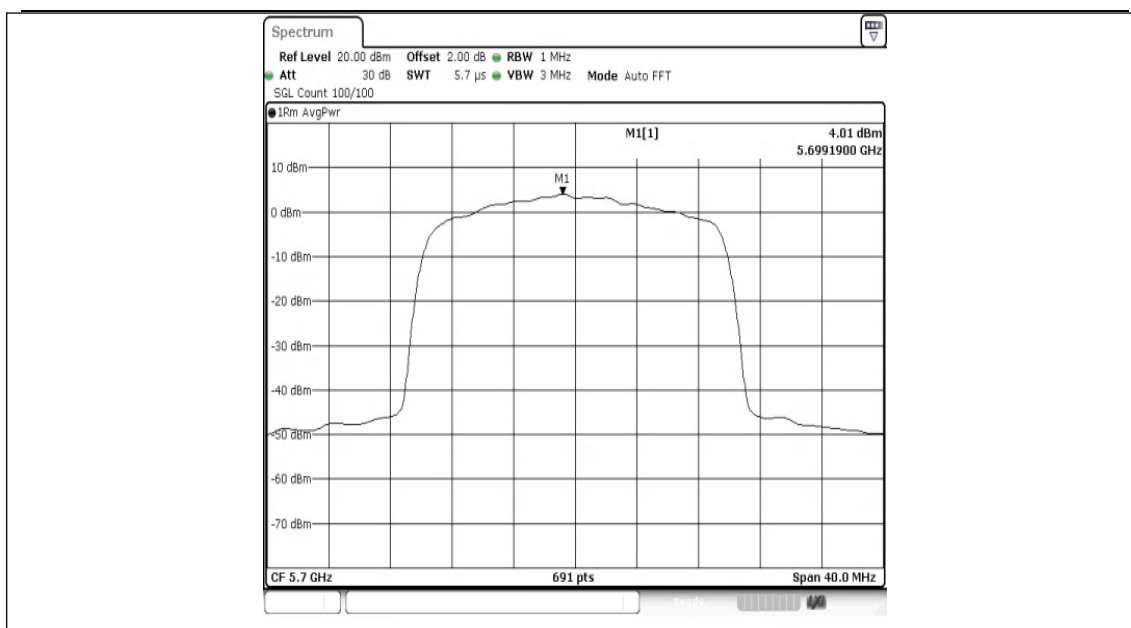


11AX20SISO-Ant1-5700-PASS

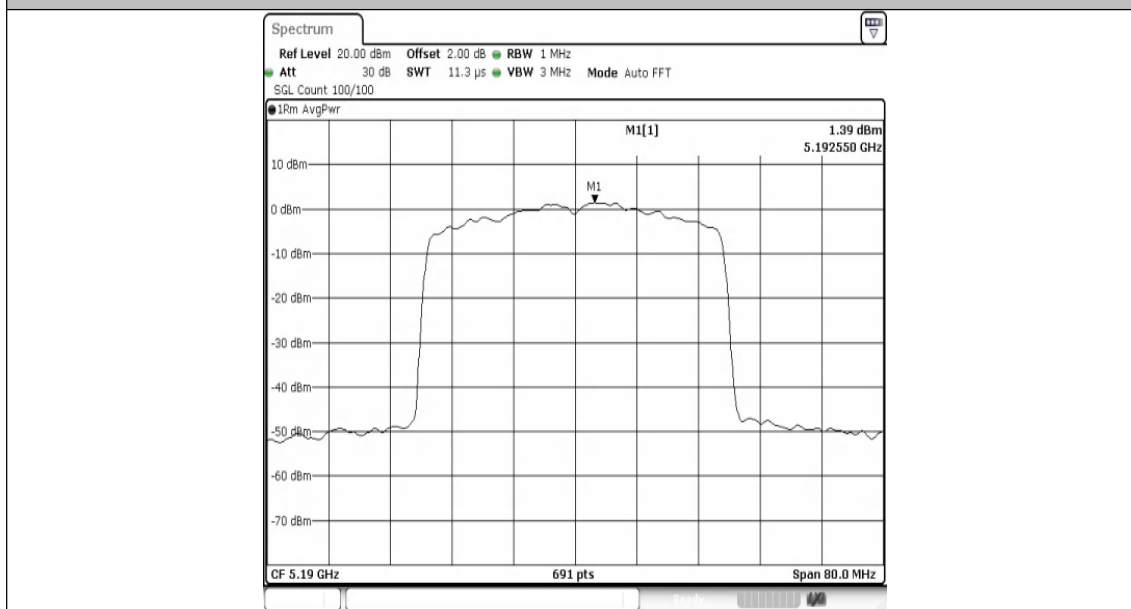


11AX40SISO-Ant1-5190-PASS

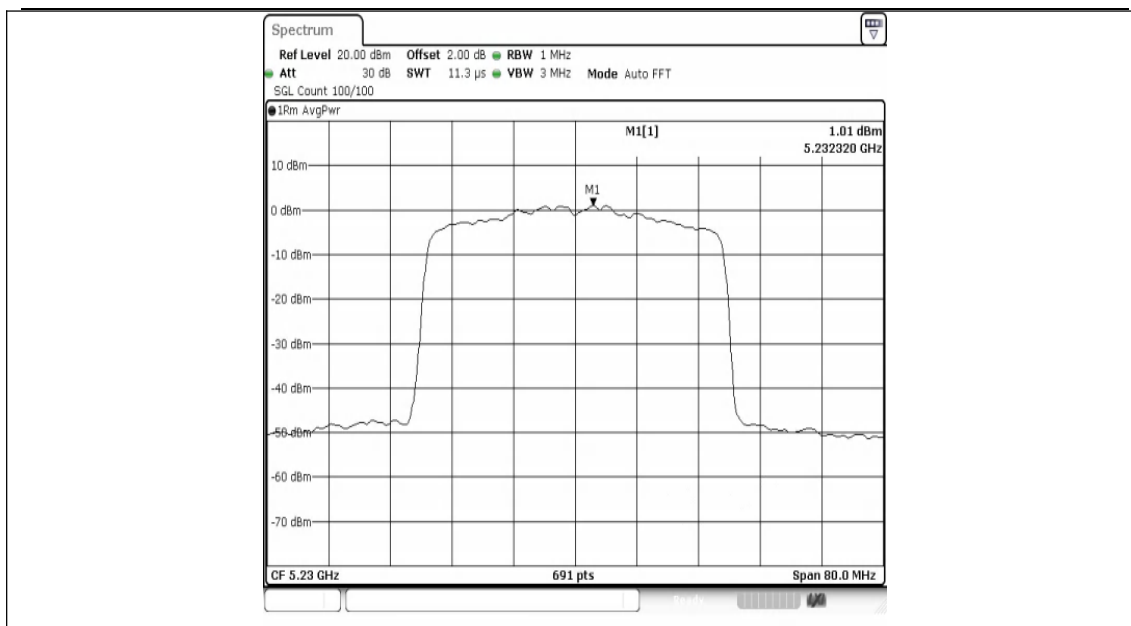

11AX40SISO-Ant1-5230-PASS

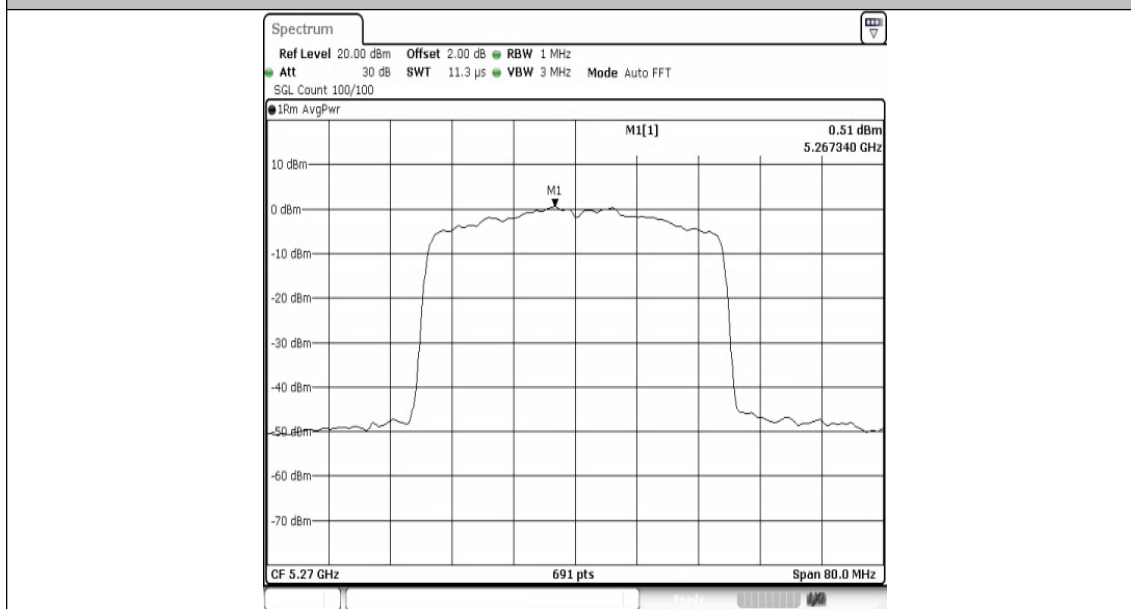


11AX40SISO-Ant1-5270-PASS

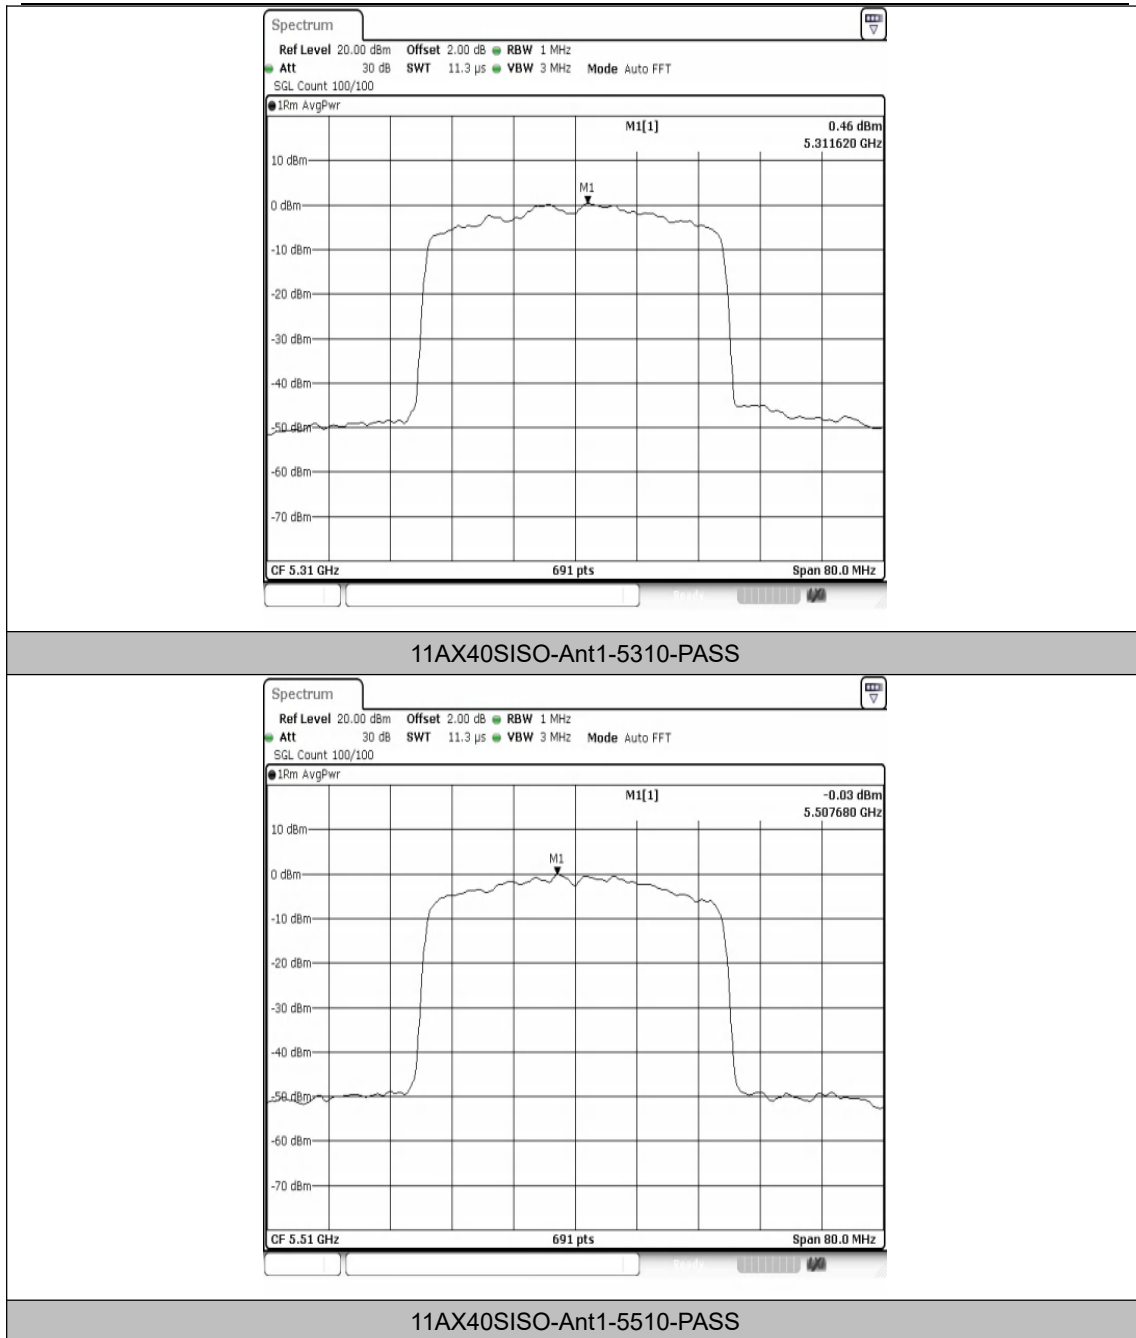

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

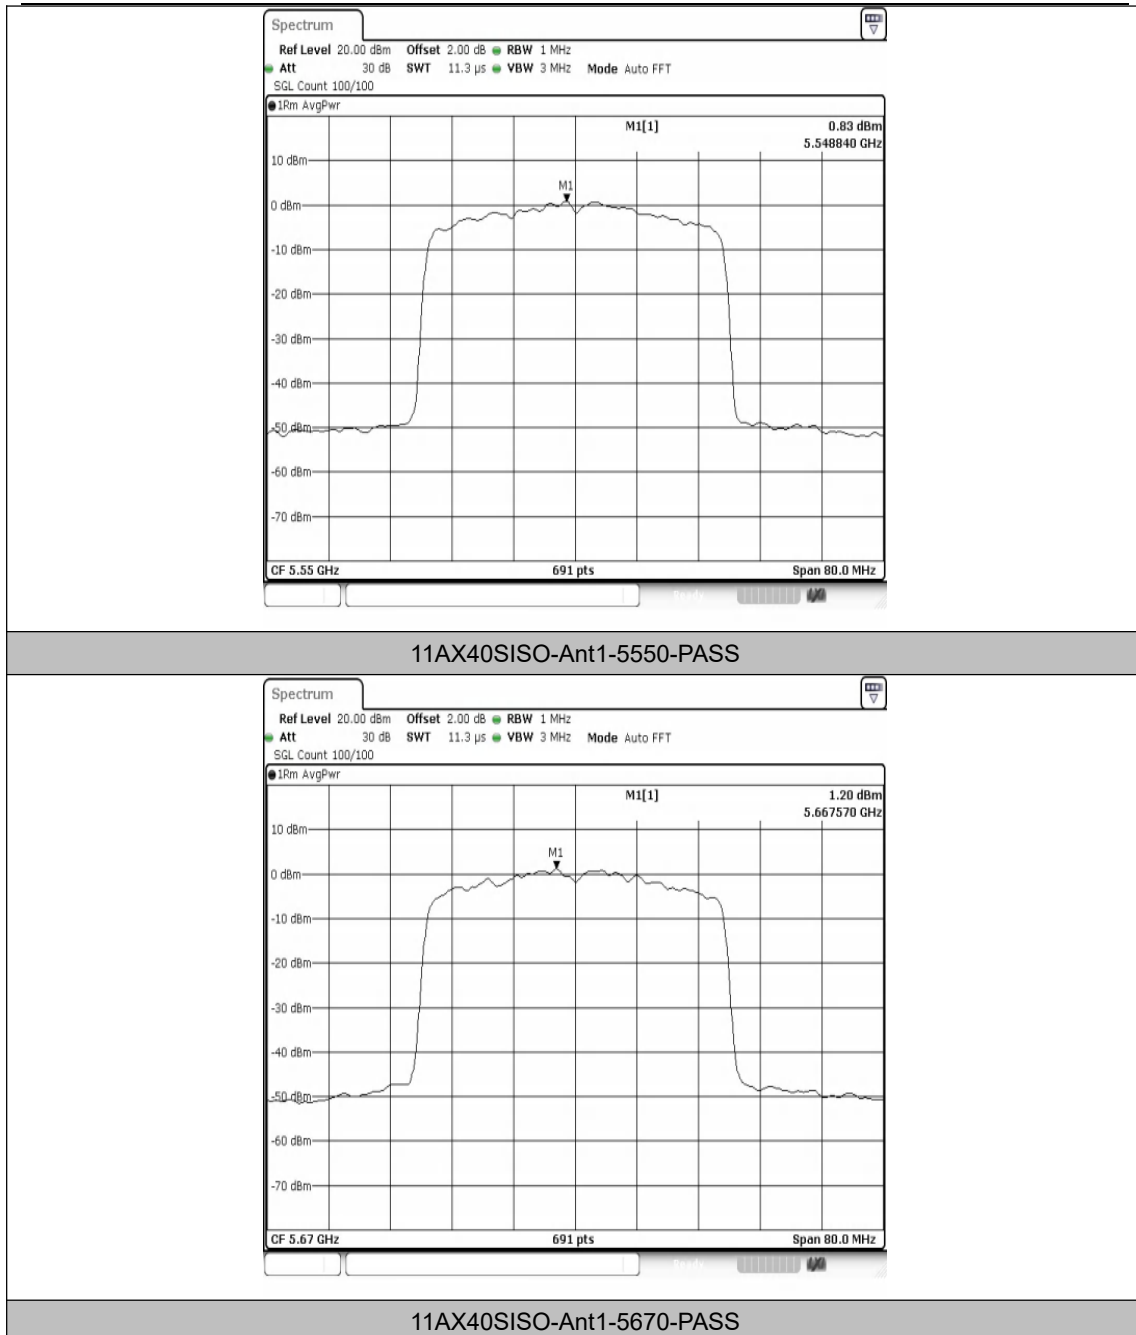


### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

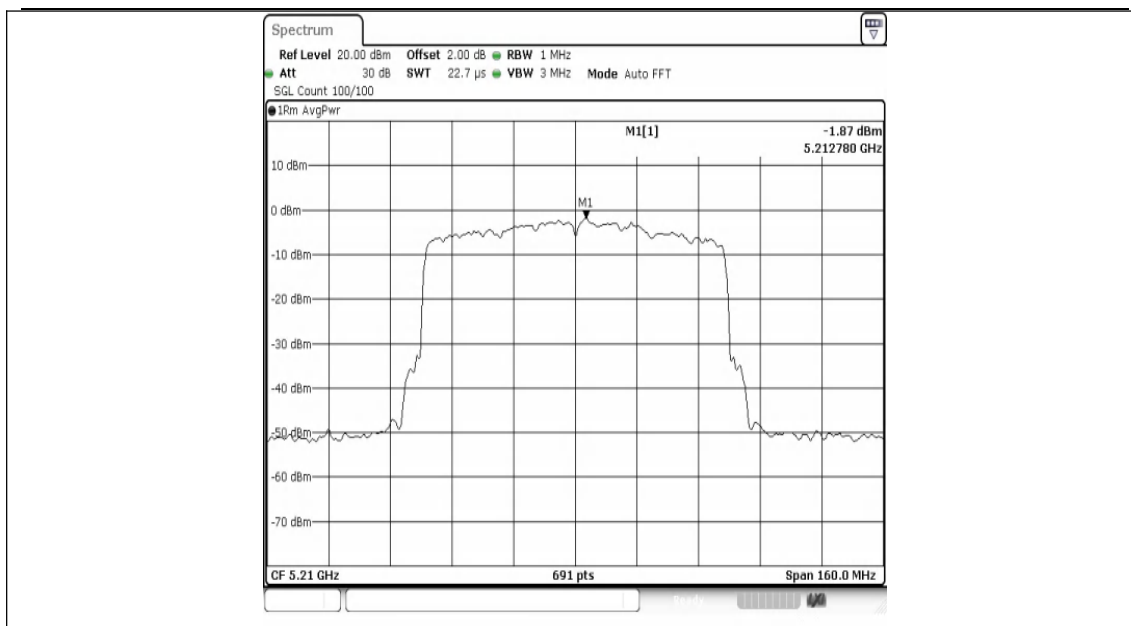

11AX80SISO-Ant1-5210-PASS

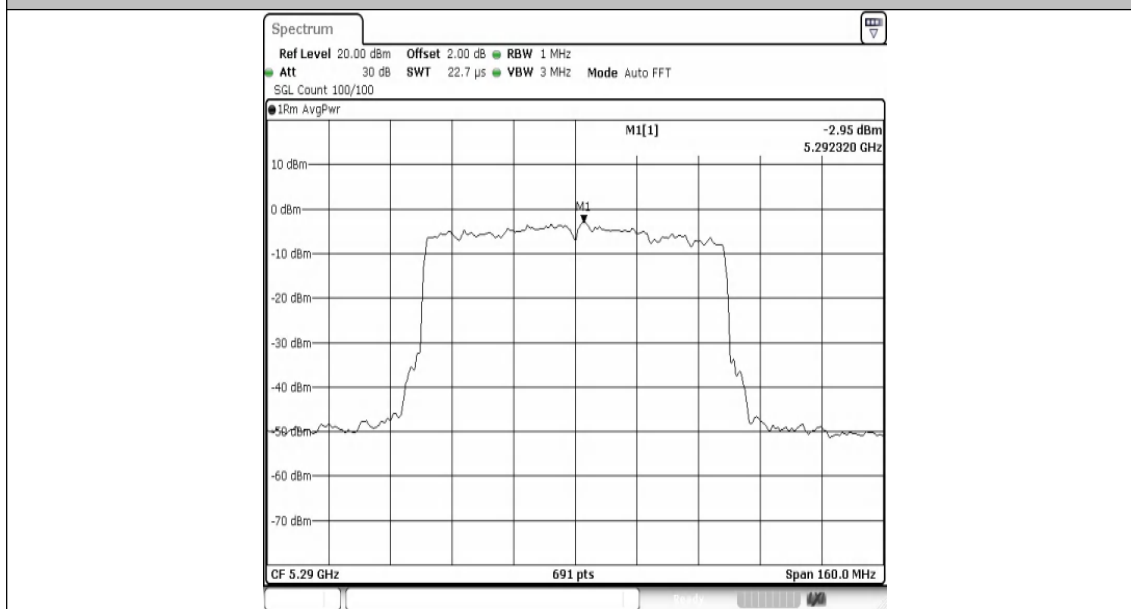

11AX80SISO-Ant1-5290-PASS

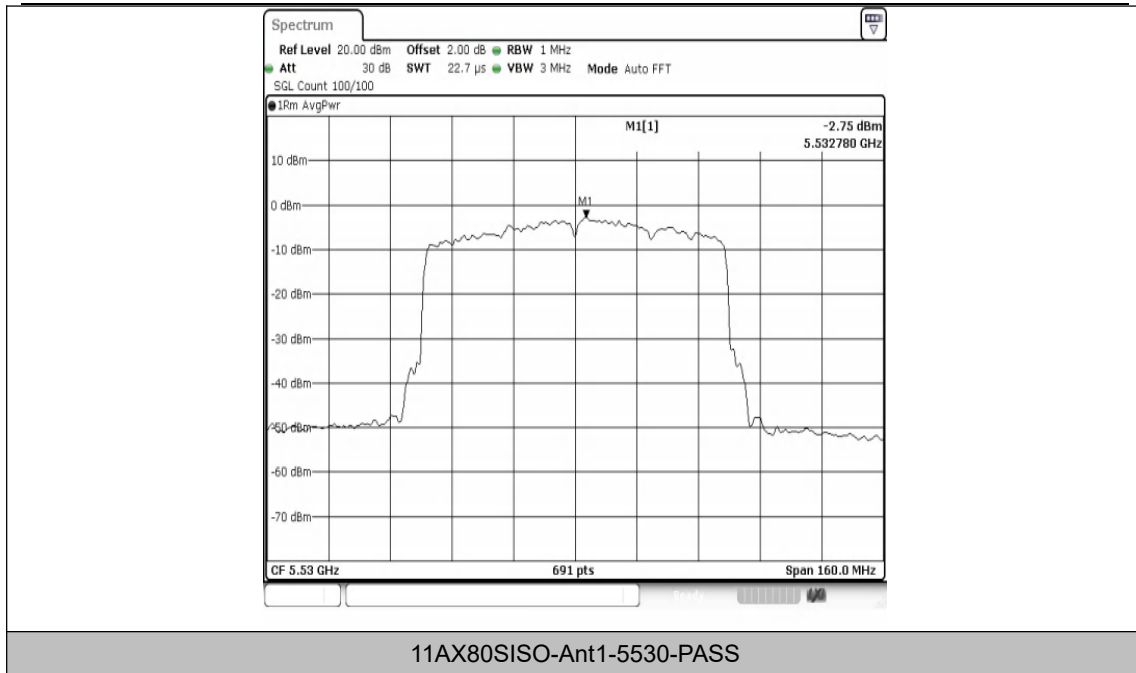


**Shenzhen Anbotek Compliance Laboratory Limited**

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)


## Test Graphs B4

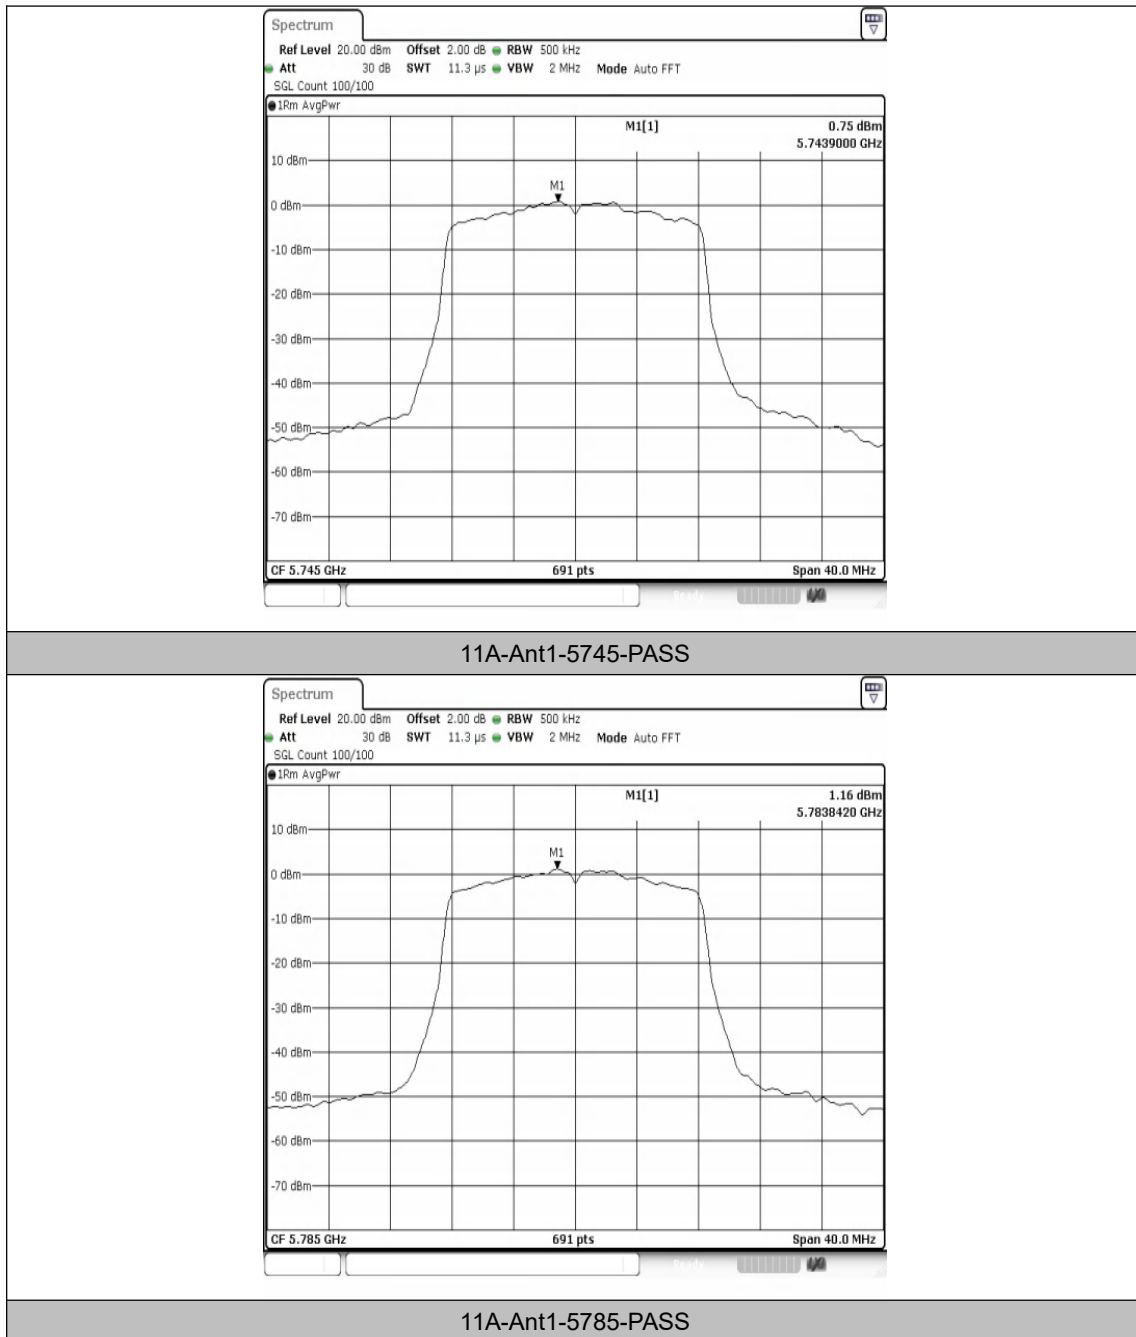

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

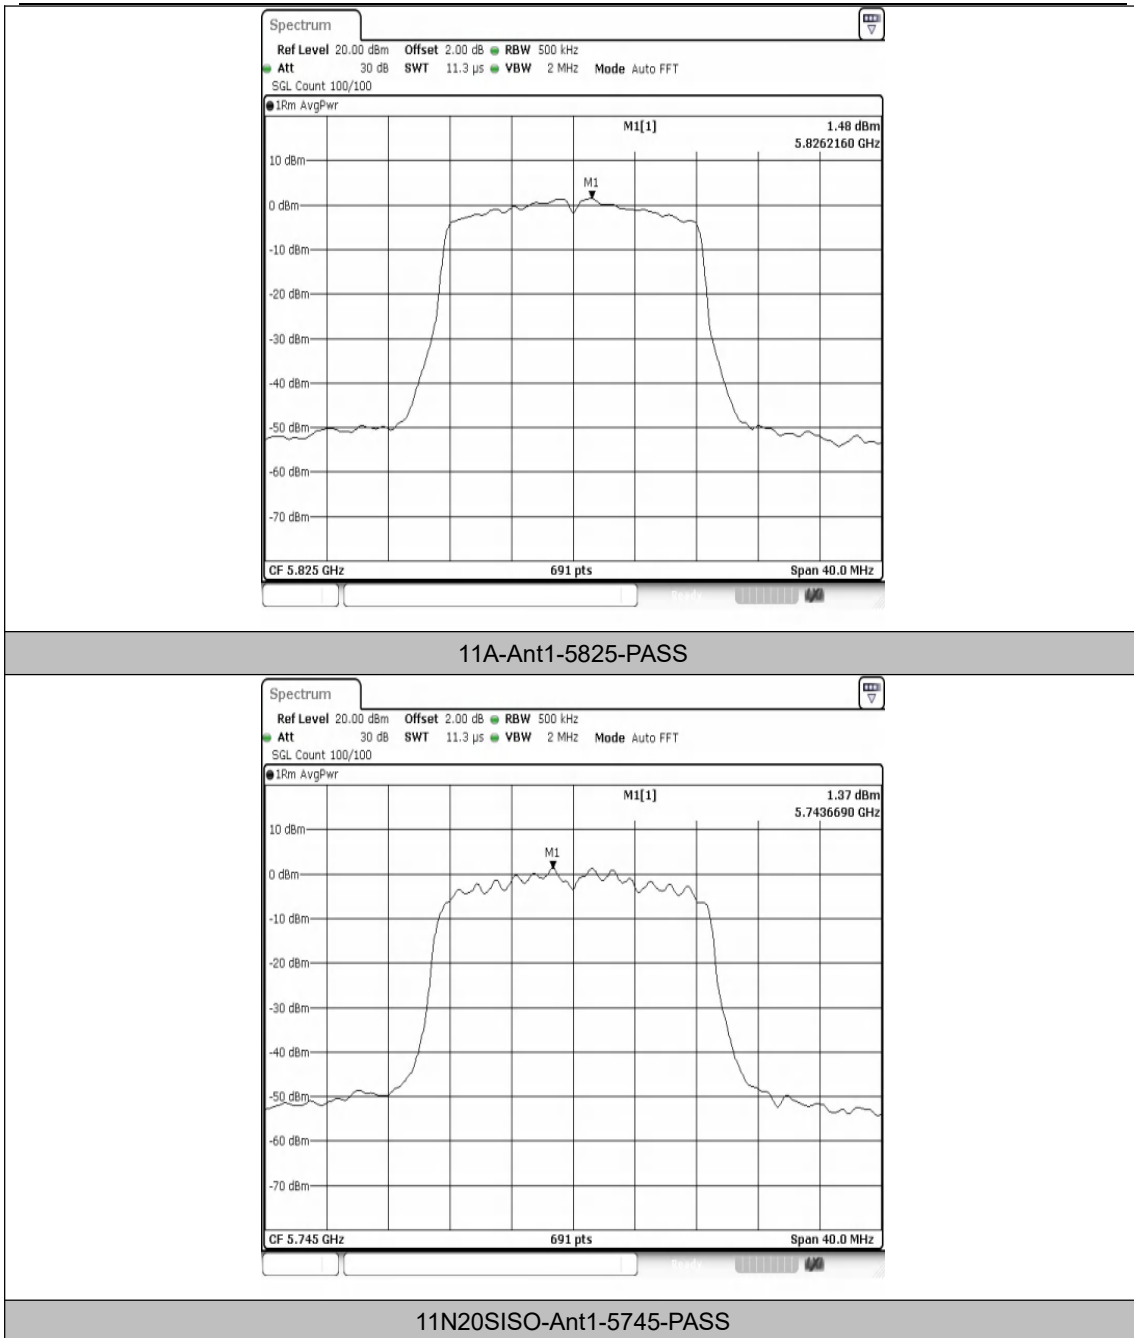

**Shenzhen Anbotek Compliance Laboratory Limited**

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

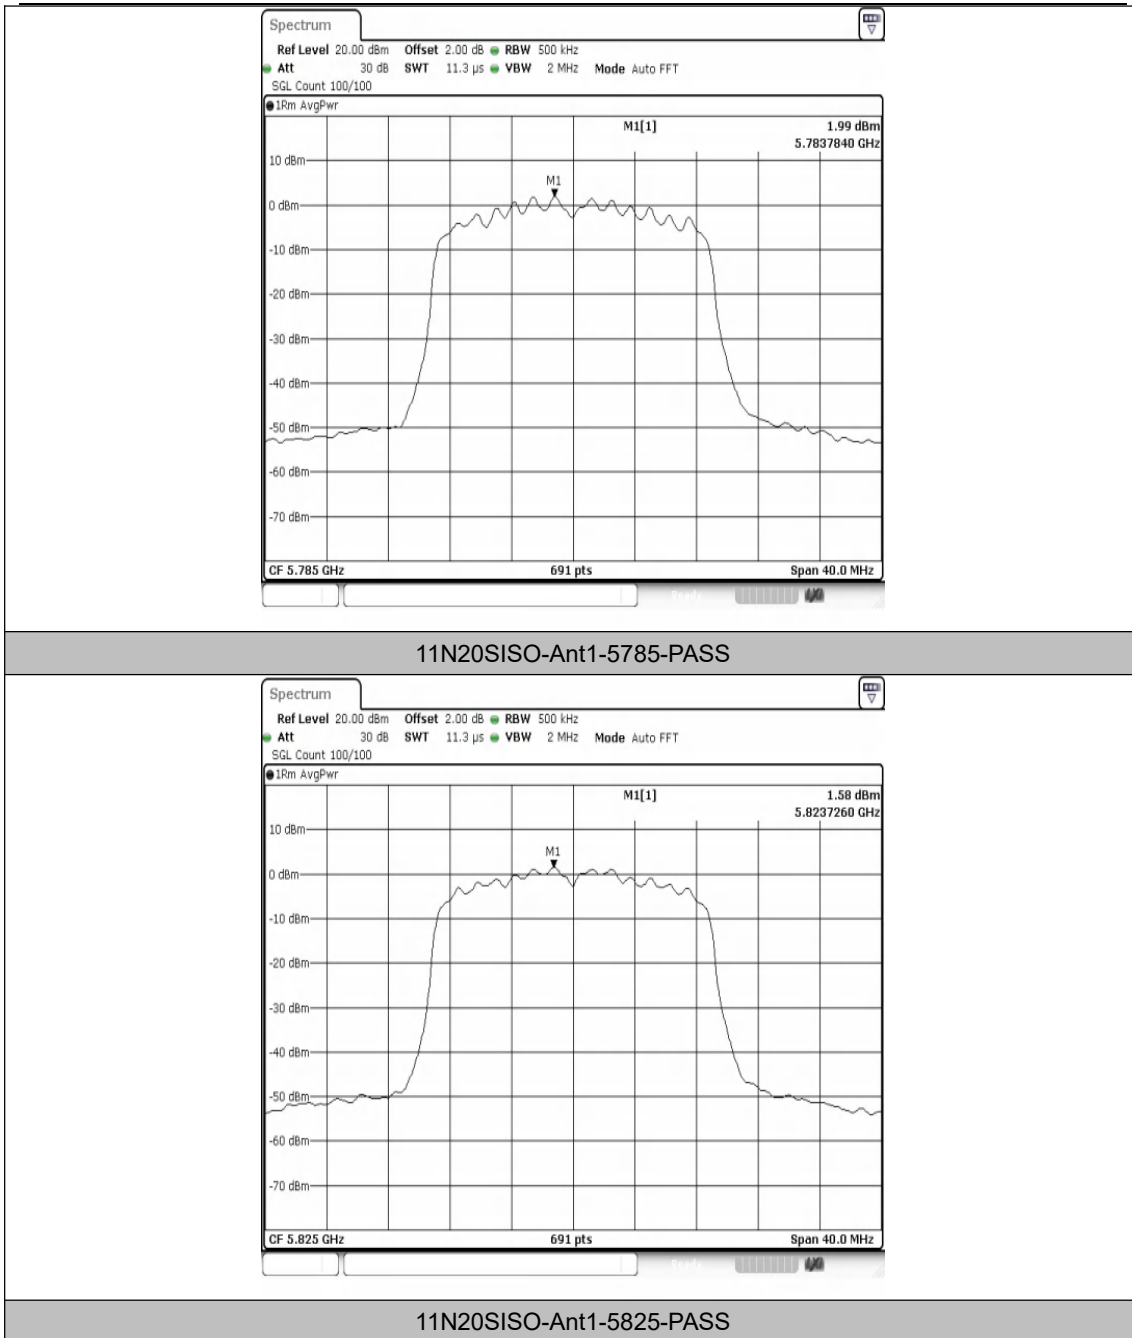


#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

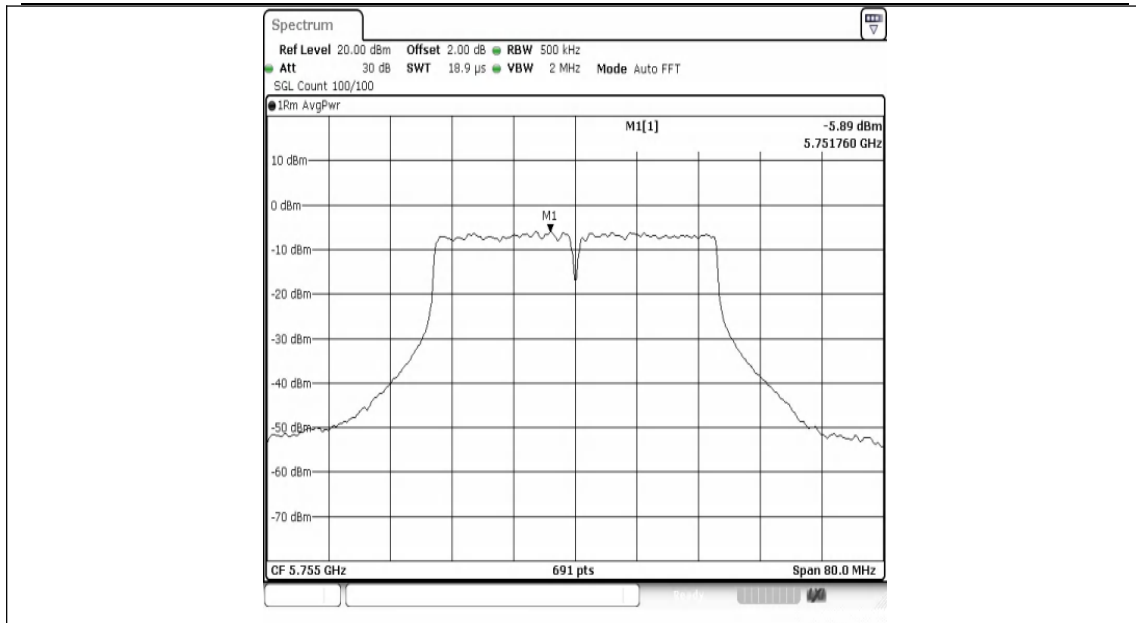

11N40SISO-Ant1-5755-PASS

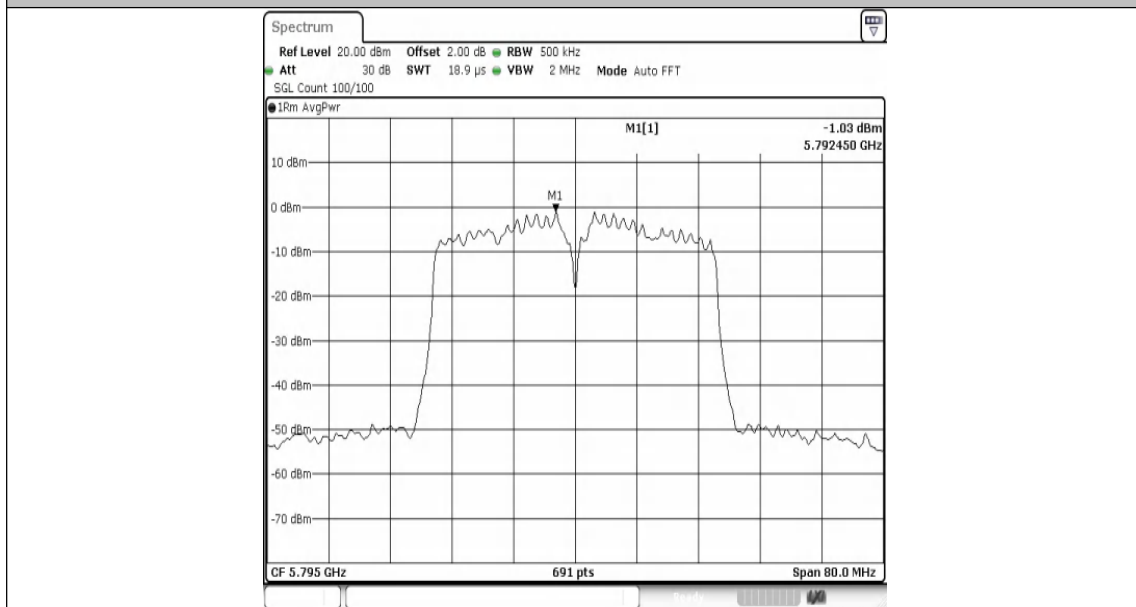


11N40SISO-Ant1-5795-PASS

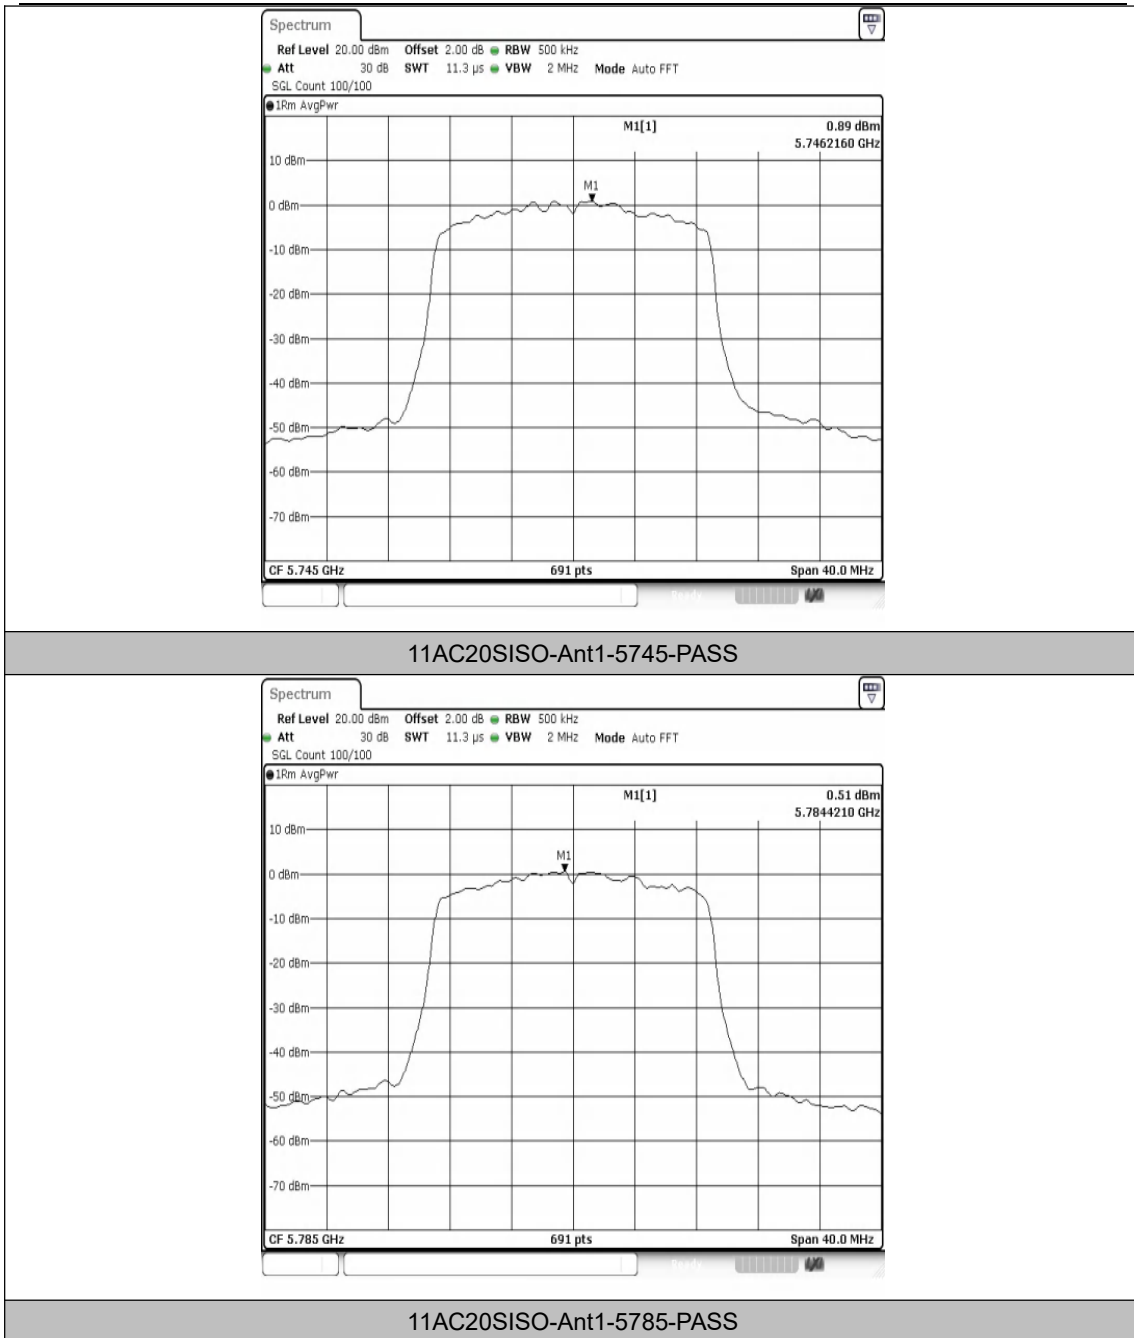


**Shenzhen Anbotek Compliance Laboratory Limited**

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

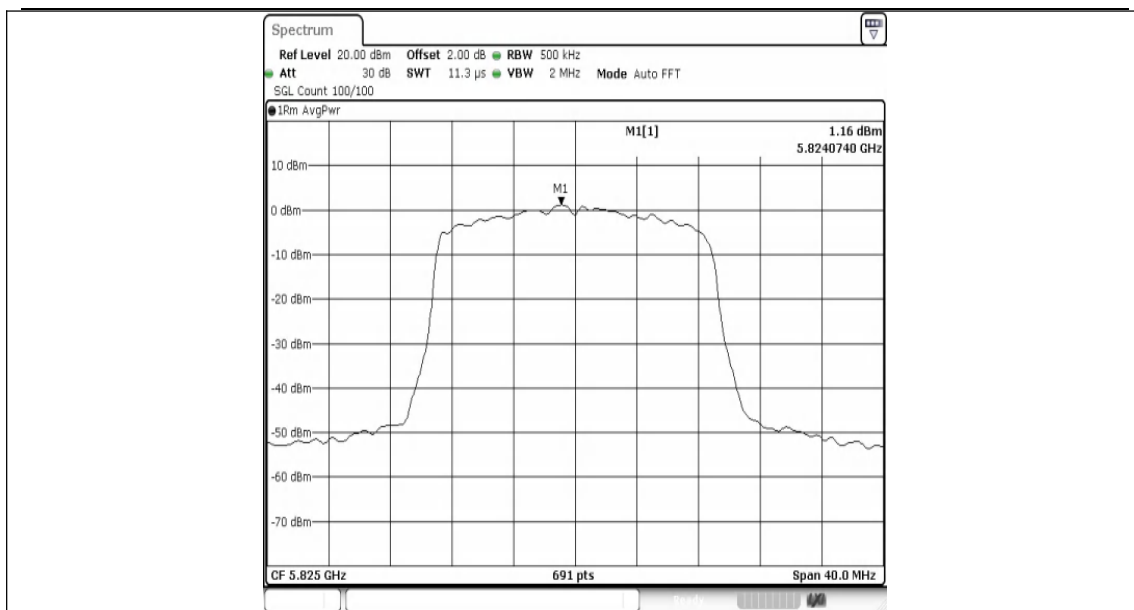


11AC20SISO-Ant1-5825-PASS

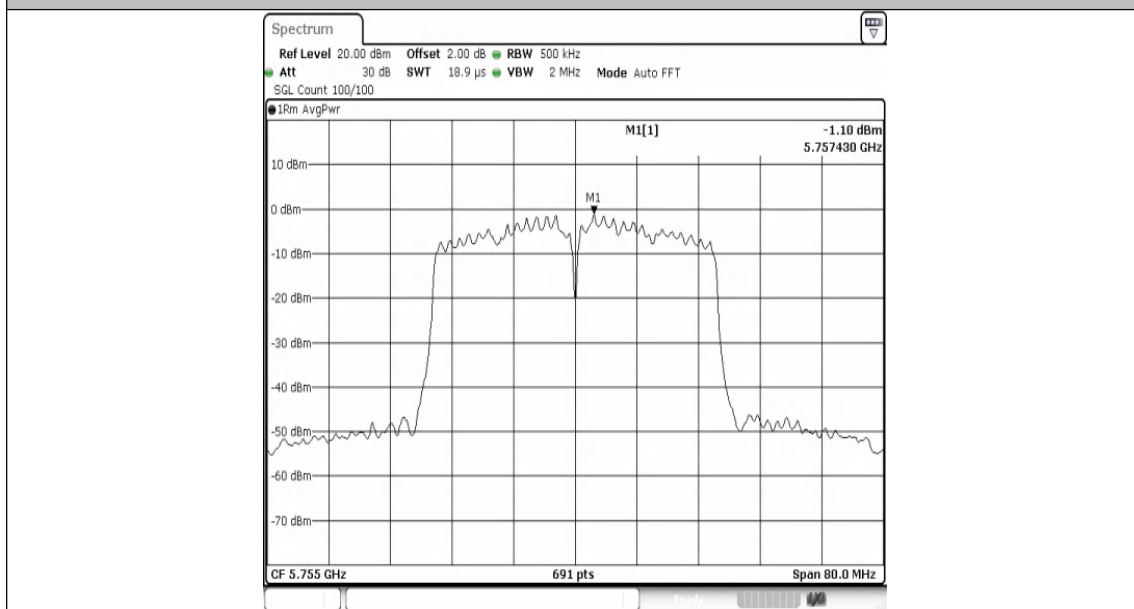


11AC40SISO-Ant1-5755-PASS

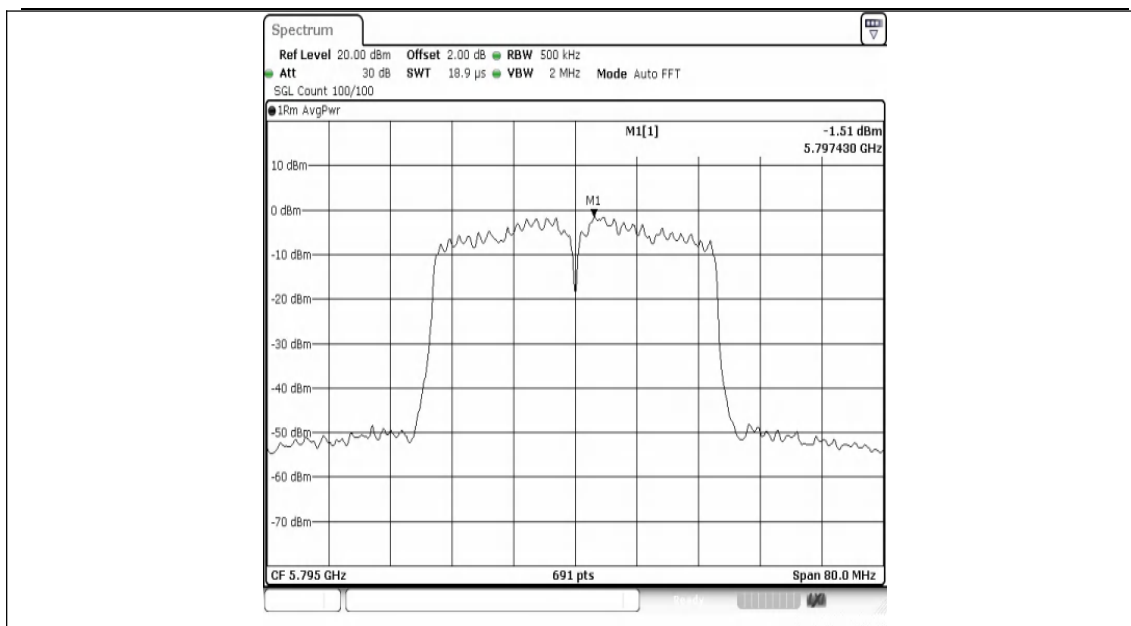


11AC40SISO-Ant1-5795-PASS

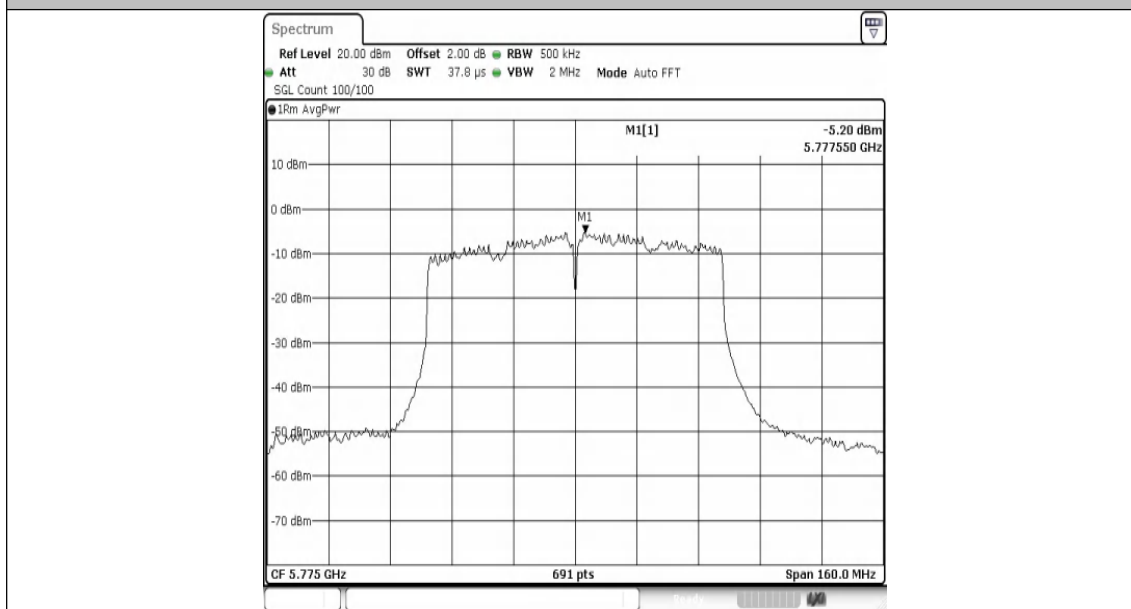

11AC80SISO-Ant1-5775-PASS

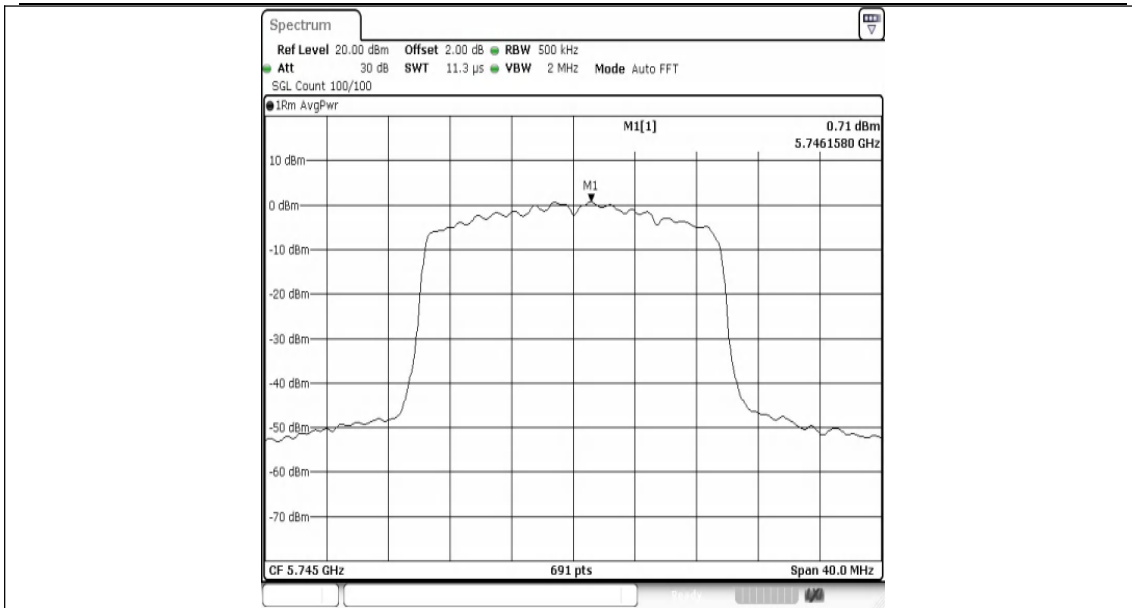

11AX20SISO-Ant1-5745-PASS

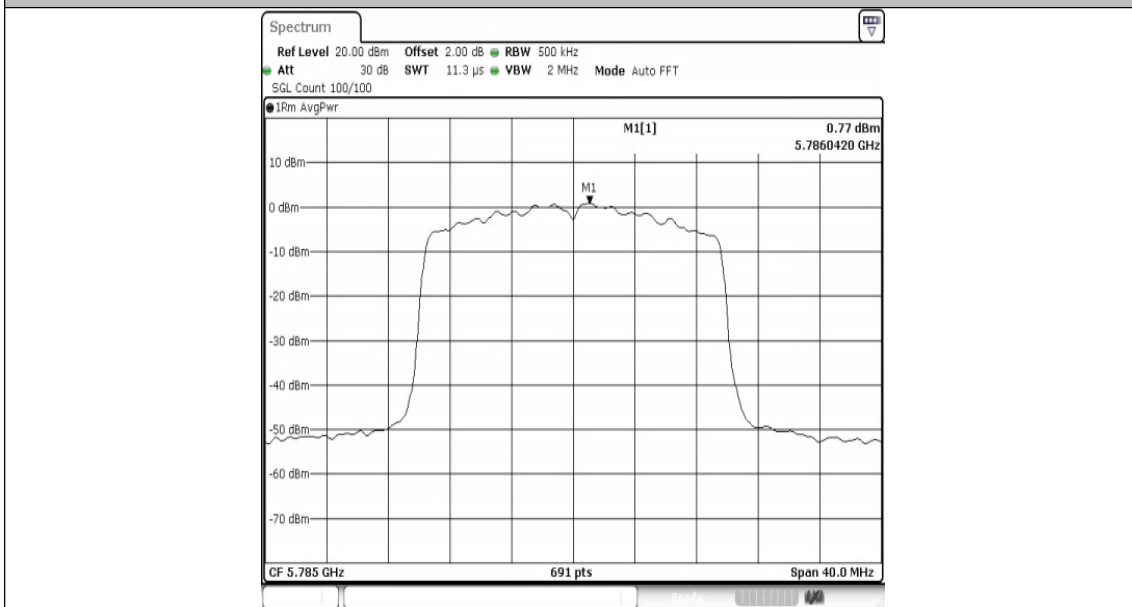


11AX20SISO-Ant1-5785-PASS


### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

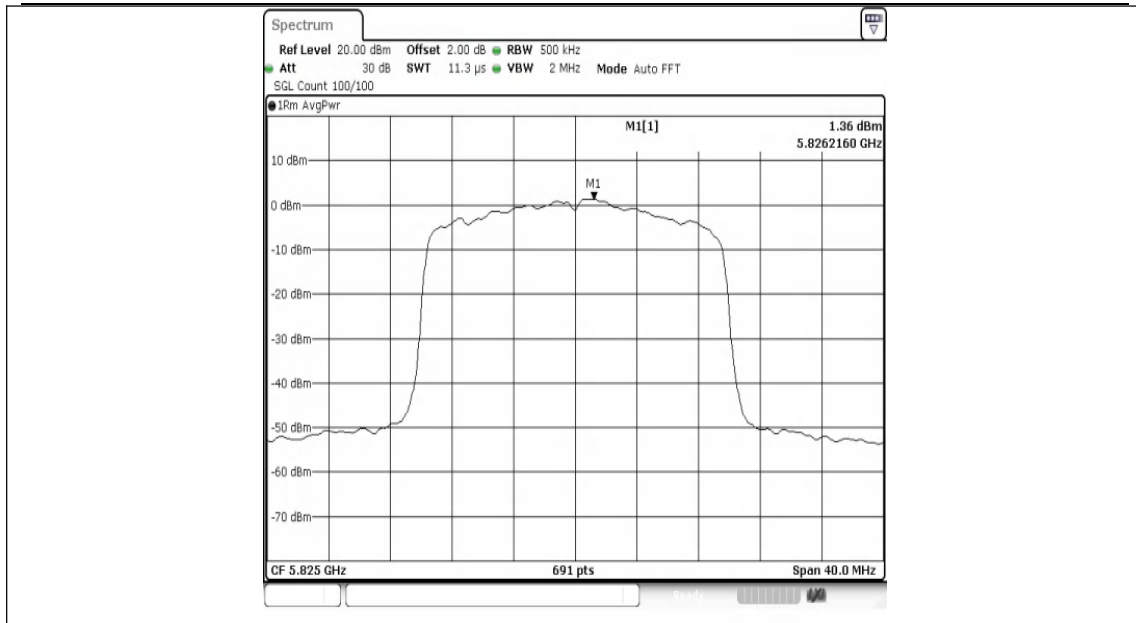

11AX20SISO-Ant1-5825-PASS

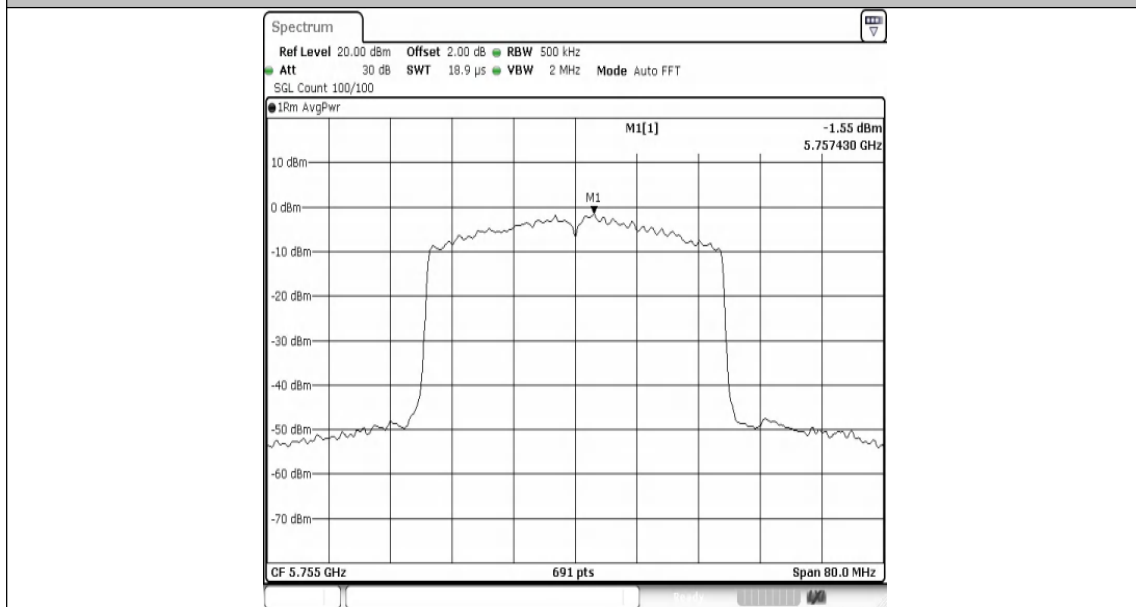


11AX40SISO-Ant1-5755-PASS


### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

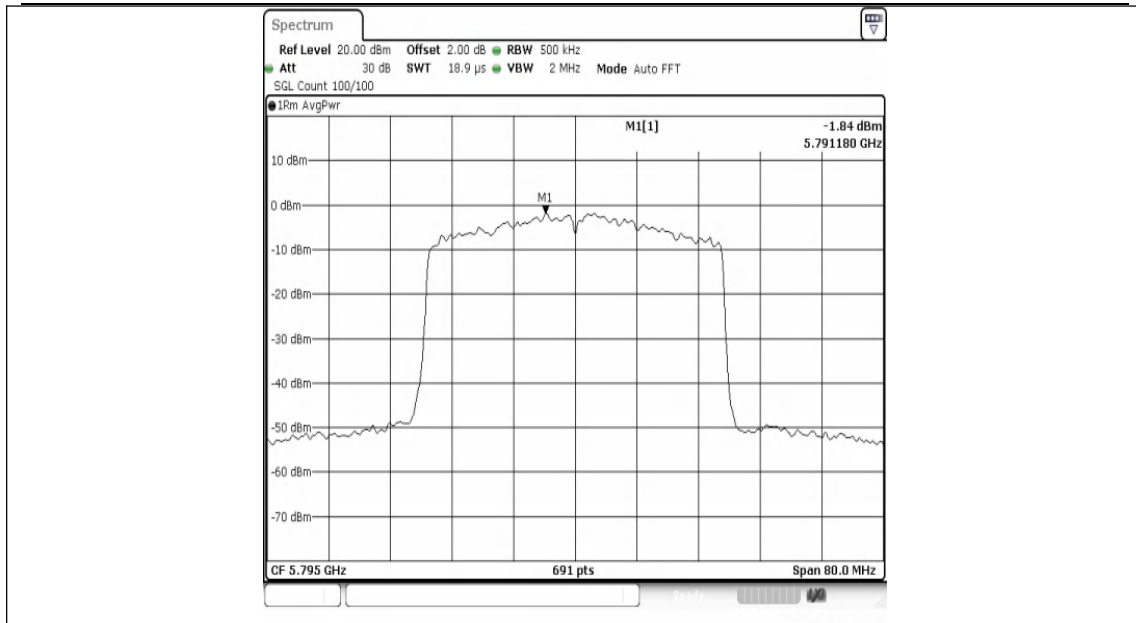

11AX40SISO-Ant1-5795-PASS

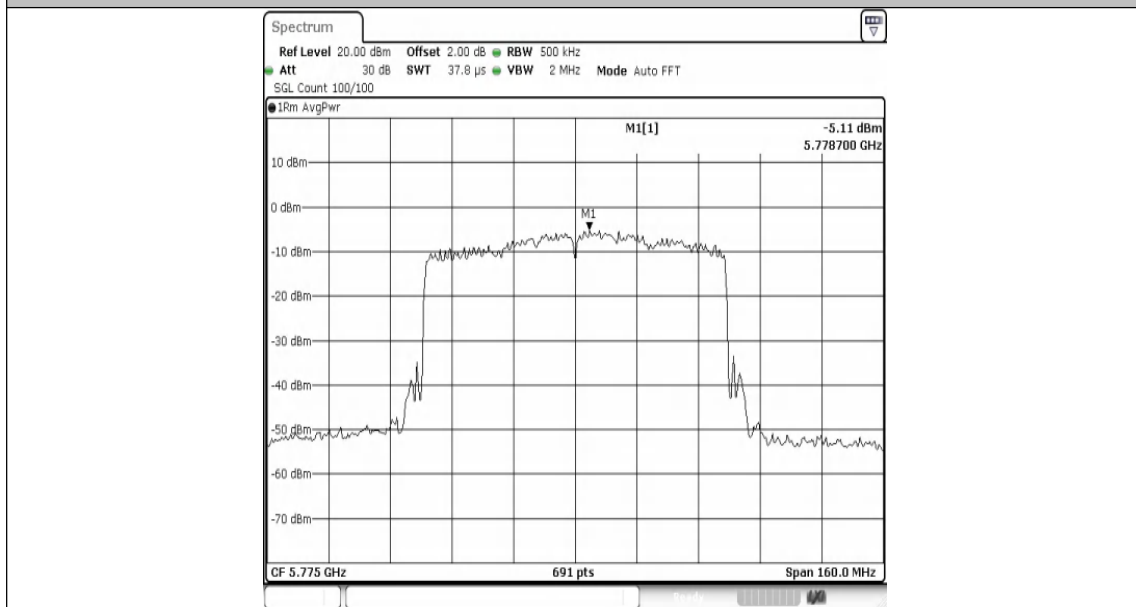

11AX80SISO-Ant1-5775-PASS

## Appendix E: Band edge measurements

### Test Result B1/2/3

| Test Mode  | Antenna | ChName | Frequency[MHz] | Result[dBm] | Limit[dBm] | Verdict |
|------------|---------|--------|----------------|-------------|------------|---------|
| 11A        | Ant1    | Low    | 5180           | -34.31      | ≤-27       | PASS    |
| 11A        | Ant1    | High   | 5320           | -36.51      | ≤-27       | PASS    |
| 11A        | Ant1    | Low    | 5500           | -32.48      | ≤-27       | PASS    |
| 11A        | Ant1    | High   | 5700           | -44.04      | ≤-27       | PASS    |
| 11N20SISO  | Ant1    | Low    | 5180           | -28.44      | ≤-27       | PASS    |
| 11N20SISO  | Ant1    | High   | 5320           | -41.9       | ≤-27       | PASS    |
| 11N20SISO  | Ant1    | Low    | 5500           | -28.97      | ≤-27       | PASS    |
| 11N20SISO  | Ant1    | High   | 5700           | -42.12      | ≤-27       | PASS    |
| 11N40SISO  | Ant1    | Low    | 5190           | -30.15      | ≤-27       | PASS    |
| 11N40SISO  | Ant1    | High   | 5310           | -34.97      | ≤-27       | PASS    |
| 11N40SISO  | Ant1    | Low    | 5510           | -37.03      | ≤-27       | PASS    |
| 11N40SISO  | Ant1    | High   | 5670           | -43.37      | ≤-27       | PASS    |
| 11AC20SISO | Ant1    | Low    | 5180           | -32.89      | ≤-27       | PASS    |
| 11AC20SISO | Ant1    | High   | 5320           | -32.92      | ≤-27       | PASS    |
| 11AC20SISO | Ant1    | Low    | 5500           | -32.68      | ≤-27       | PASS    |
| 11AC20SISO | Ant1    | High   | 5700           | -43.86      | ≤-27       | PASS    |
| 11AC40SISO | Ant1    | Low    | 5190           | -35.29      | ≤-27       | PASS    |
| 11AC40SISO | Ant1    | High   | 5310           | -33.43      | ≤-27       | PASS    |
| 11AC40SISO | Ant1    | Low    | 5510           | -31.9       | ≤-27       | PASS    |
| 11AC40SISO | Ant1    | High   | 5670           | -31.62      | ≤-27       | PASS    |
| 11AC80SISO | Ant1    | Low    | 5210           | -33.08      | ≤-27       | PASS    |
| 11AC80SISO | Ant1    | High   | 5290           | -37.25      | ≤-27       | PASS    |
| 11AC80SISO | Ant1    | Low    | 5530           | -36.72      | ≤-27       | PASS    |
| 11AX20SISO | Ant1    | Low    | 5180           | -32.87      | ≤-27       | PASS    |
| 11AX20SISO | Ant1    | High   | 5320           | -33.41      | ≤-27       | PASS    |
| 11AX20SISO | Ant1    | Low    | 5500           | -33.69      | ≤-27       | PASS    |
| 11AX20SISO | Ant1    | High   | 5700           | -40.56      | ≤-27       | PASS    |
| 11AX40SISO | Ant1    | Low    | 5190           | -27.81      | ≤-27       | PASS    |
| 11AX40SISO | Ant1    | High   | 5310           | -37.52      | ≤-27       | PASS    |
| 11AX40SISO | Ant1    | Low    | 5510           | -29.24      | ≤-27       | PASS    |
| 11AX40SISO | Ant1    | High   | 5670           | -29.2       | ≤-27       | PASS    |
| 11AX80SISO | Ant1    | Low    | 5210           | -28.65      | ≤-27       | PASS    |
| 11AX80SISO | Ant1    | High   | 5290           | -34.72      | ≤-27       | PASS    |
| 11AX80SISO | Ant1    | Low    | 5530           | -29.43      | ≤-27       | PASS    |

Note: The margin plus the antenna gain also meets the limit.

## Test Result B4

| Test Mode  | Antenna | Ch. Name | Frequency[MHz] | FreqRange [MHz] | Result [dBm] | Limit [dBm] | Verdict |
|------------|---------|----------|----------------|-----------------|--------------|-------------|---------|
| 11A        | Ant1    | Low      | 5745           | 5720~5725       | -29.49       | ≤27.00      | PASS    |
| 11A        | Ant1    | Low      | 5745           | 5700~5720       | -43.97       | ≤10.23      | PASS    |
| 11A        | Ant1    | Low      | 5745           | 5650~5700       | -45.25       | ≤-26.88     | PASS    |
| 11A        | Ant1    | Low      | 5745           | 5760~5650       | -45.35       | ≤-27        | PASS    |
| 11A        | Ant1    | High     | 5825           | 5850~5855       | -42.1        | ≤15.65      | PASS    |
| 11A        | Ant1    | High     | 5825           | 5855~5875       | -40.97       | ≤11.44      | PASS    |
| 11A        | Ant1    | High     | 5825           | 5875~5925       | -45.52       | ≤-25.42     | PASS    |
| 11A        | Ant1    | High     | 5825           | 5925~5935       | -44.56       | ≤-27        | PASS    |
| 11N20SISO  | Ant1    | Low      | 5745           | 5720~5725       | -36.72       | ≤16.36      | PASS    |
| 11N20SISO  | Ant1    | Low      | 5745           | 5700~5720       | -38.47       | ≤12.15      | PASS    |
| 11N20SISO  | Ant1    | Low      | 5745           | 5650~5700       | -45.56       | ≤-25.40     | PASS    |
| 11N20SISO  | Ant1    | Low      | 5745           | 5760~5650       | -46          | ≤-27        | PASS    |
| 11N20SISO  | Ant1    | High     | 5825           | 5850~5855       | -41.77       | ≤16.10      | PASS    |
| 11N20SISO  | Ant1    | High     | 5825           | 5855~5875       | -44.03       | ≤10.51      | PASS    |
| 11N20SISO  | Ant1    | High     | 5825           | 5875~5925       | -46.06       | ≤-26.87     | PASS    |
| 11N20SISO  | Ant1    | High     | 5825           | 5925~5935       | -44.03       | ≤-27        | PASS    |
| 11N40SISO  | Ant1    | Low      | 5755           | 5720~5725       | -37.8        | ≤17.68      | PASS    |
| 11N40SISO  | Ant1    | Low      | 5755           | 5700~5720       | -35.93       | ≤15.20      | PASS    |
| 11N40SISO  | Ant1    | Low      | 5755           | 5650~5700       | -46.38       | ≤-26.07     | PASS    |
| 11N40SISO  | Ant1    | Low      | 5755           | 5780~5650       | -45.39       | ≤-27        | PASS    |
| 11N40SISO  | Ant1    | High     | 5795           | 5850~5855       | -45.08       | ≤15.85      | PASS    |
| 11N40SISO  | Ant1    | High     | 5795           | 5855~5875       | -44          | ≤10.61      | PASS    |
| 11N40SISO  | Ant1    | High     | 5795           | 5875~5925       | -45.96       | ≤-26.26     | PASS    |
| 11N40SISO  | Ant1    | High     | 5795           | 5925~5935       | -45.75       | ≤-27        | PASS    |
| 11AC20SISO | Ant1    | Low      | 5745           | 5720~5725       | -38.42       | ≤15.98      | PASS    |
| 11AC20SISO | Ant1    | Low      | 5745           | 5700~5720       | -44.42       | ≤10.14      | PASS    |
| 11AC20SISO | Ant1    | Low      | 5745           | 5650~5700       | -46.31       | ≤-26.26     | PASS    |
| 11AC20SISO | Ant1    | Low      | 5745           | 5760~5650       | -44.65       | ≤-27        | PASS    |
| 11AC20SISO | Ant1    | High     | 5825           | 5850~5855       | -43.2        | ≤15.65      | PASS    |
| 11AC20SISO | Ant1    | High     | 5825           | 5855~5875       | -42.63       | ≤11.28      | PASS    |
| 11AC20SISO | Ant1    | High     | 5825           | 5875~5925       | -45.12       | ≤-26.87     | PASS    |
| 11AC20SISO | Ant1    | High     | 5825           | 5925~5935       | -44.01       | ≤-27        | PASS    |
| 11AC40SISO | Ant1    | Low      | 5755           | 5720~5725       | -37.71       | ≤15.90      | PASS    |
| 11AC40SISO | Ant1    | Low      | 5755           | 5700~5720       | -35.43       | ≤14.92      | PASS    |
| 11AC40SISO | Ant1    | Low      | 5755           | 5650~5700       | -46.28       | ≤-25.63     | PASS    |
| 11AC40SISO | Ant1    | Low      | 5755           | 5780~5650       | -45.47       | ≤-27        | PASS    |
| 11AC40SISO | Ant1    | High     | 5795           | 5850~5855       | -41.75       | ≤17.48      | PASS    |
| 11AC40SISO | Ant1    | High     | 5795           | 5855~5875       | -43.83       | ≤10.34      | PASS    |
| 11AC40SISO | Ant1    | High     | 5795           | 5875~5925       | -45.53       | ≤-26.61     | PASS    |

### Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)


|            |      |      |      |           |        |         |      |
|------------|------|------|------|-----------|--------|---------|------|
| 11AC40SISO | Ant1 | High | 5795 | 5925~5935 | -45.22 | ≤-27    | PASS |
| 11AC80SISO | Ant1 | Low  | 5775 | 5720~5725 | -38.83 | ≤17.20  | PASS |
| 11AC80SISO | Ant1 | Low  | 5775 | 5700~5720 | -37.37 | ≤10.07  | PASS |
| 11AC80SISO | Ant1 | Low  | 5775 | 5650~5700 | -46.43 | ≤-26.54 | PASS |
| 11AC80SISO | Ant1 | Low  | 5775 | 5800~5650 | -45.53 | ≤-27    | PASS |
| 11AC80SISO | Ant1 | High | 5775 | 5850~5855 | -37.74 | ≤15.98  | PASS |
| 11AC80SISO | Ant1 | High | 5775 | 5855~5875 | -31.81 | ≤12.57  | PASS |
| 11AC80SISO | Ant1 | High | 5775 | 5875~5925 | -46.08 | ≤-26.66 | PASS |
| 11AC80SISO | Ant1 | High | 5775 | 5925~5935 | -43.66 | ≤-27    | PASS |
| 11AX20SISO | Ant1 | Low  | 5745 | 5720~5725 | -30.05 | ≤20.92  | PASS |
| 11AX20SISO | Ant1 | Low  | 5745 | 5700~5720 | -43.65 | ≤10.98  | PASS |
| 11AX20SISO | Ant1 | Low  | 5745 | 5650~5700 | -47.19 | ≤-26.75 | PASS |
| 11AX20SISO | Ant1 | Low  | 5745 | 5760~5650 | -45.39 | ≤-27    | PASS |
| 11AX20SISO | Ant1 | High | 5825 | 5850~5855 | -28.13 | ≤19.22  | PASS |
| 11AX20SISO | Ant1 | High | 5825 | 5855~5875 | -37.03 | ≤14.40  | PASS |
| 11AX20SISO | Ant1 | High | 5825 | 5875~5925 | -45.19 | ≤-26.87 | PASS |
| 11AX20SISO | Ant1 | High | 5825 | 5925~5935 | -45.2  | ≤-27    | PASS |
| 11AX40SISO | Ant1 | Low  | 5755 | 5720~5725 | -37.01 | ≤16.34  | PASS |
| 11AX40SISO | Ant1 | Low  | 5755 | 5700~5720 | -36.92 | ≤13.66  | PASS |
| 11AX40SISO | Ant1 | Low  | 5755 | 5650~5700 | -45.96 | ≤-26.65 | PASS |
| 11AX40SISO | Ant1 | Low  | 5755 | 5780~5650 | -44.3  | ≤-27    | PASS |
| 11AX40SISO | Ant1 | High | 5795 | 5850~5855 | -41.23 | ≤16.39  | PASS |
| 11AX40SISO | Ant1 | High | 5795 | 5855~5875 | -44.69 | ≤10.21  | PASS |
| 11AX40SISO | Ant1 | High | 5795 | 5875~5925 | -45.81 | ≤-26.97 | PASS |
| 11AX40SISO | Ant1 | High | 5795 | 5925~5935 | -45.07 | ≤-27    | PASS |
| 11AX80SISO | Ant1 | Low  | 5775 | 5720~5725 | -37.83 | ≤15.67  | PASS |
| 11AX80SISO | Ant1 | Low  | 5775 | 5700~5720 | -36.64 | ≤12.02  | PASS |
| 11AX80SISO | Ant1 | Low  | 5775 | 5650~5700 | -46.2  | ≤-26.38 | PASS |
| 11AX80SISO | Ant1 | Low  | 5775 | 5800~5650 | -44.85 | ≤-27    | PASS |
| 11AX80SISO | Ant1 | High | 5775 | 5850~5855 | -37.16 | ≤15.98  | PASS |
| 11AX80SISO | Ant1 | High | 5775 | 5855~5875 | -32.94 | ≤12.19  | PASS |
| 11AX80SISO | Ant1 | High | 5775 | 5875~5925 | -45.16 | ≤-26.46 | PASS |
| 11AX80SISO | Ant1 | High | 5775 | 5925~5935 | -44.07 | ≤-27    | PASS |


Note: The margin plus the antenna gain also meets the limit.


Test Graphs B1/2/3

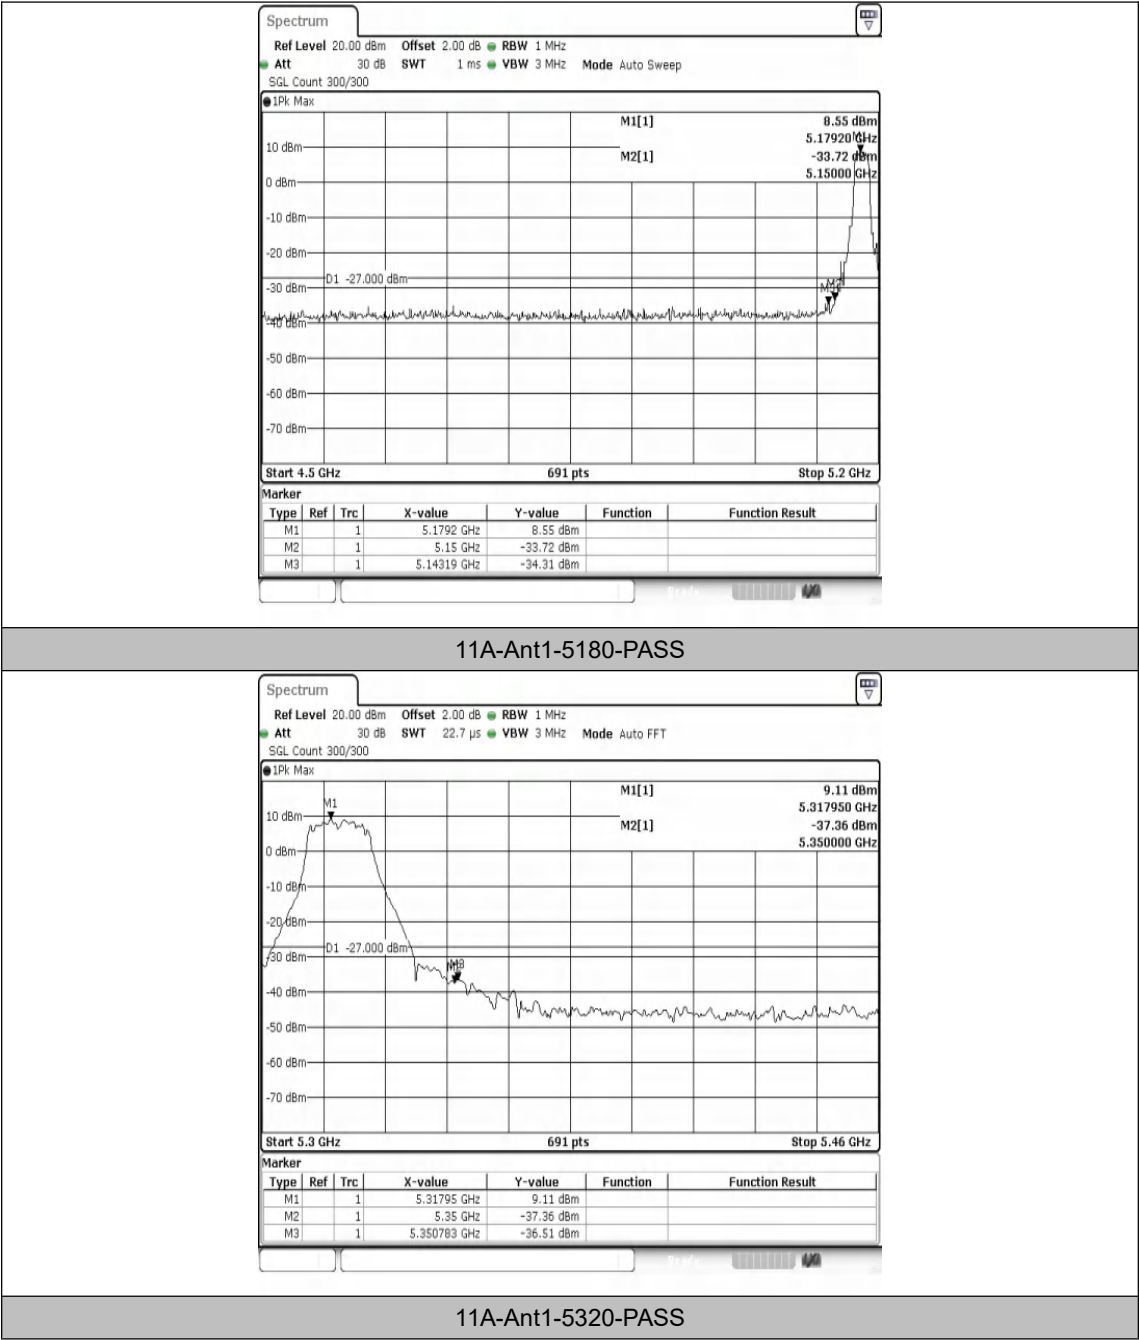


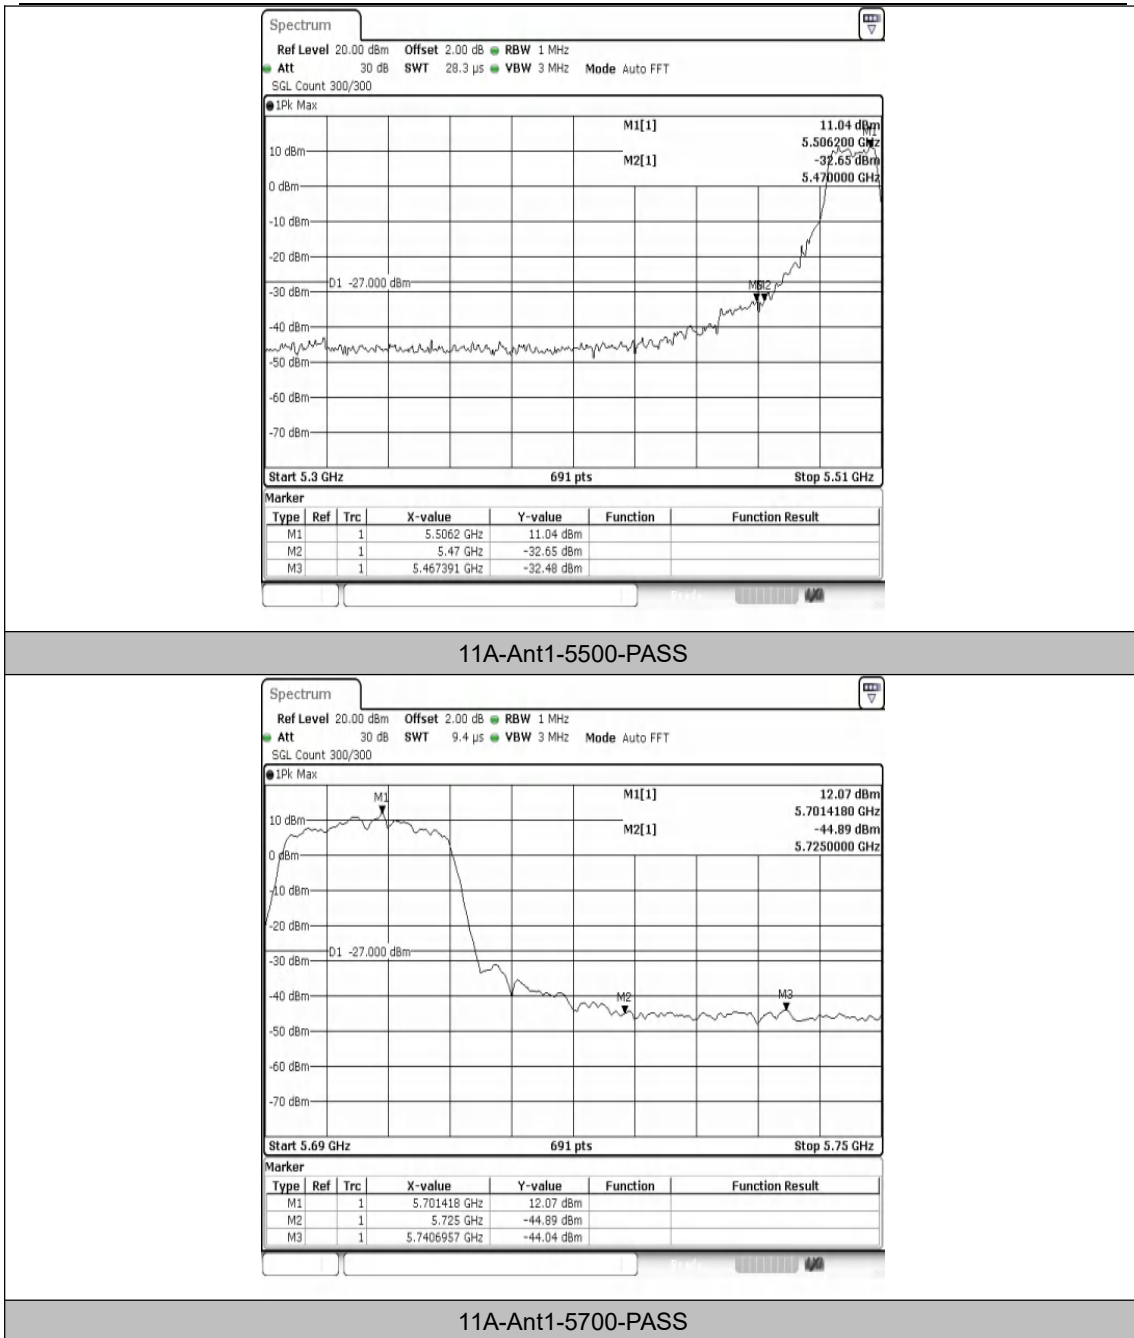


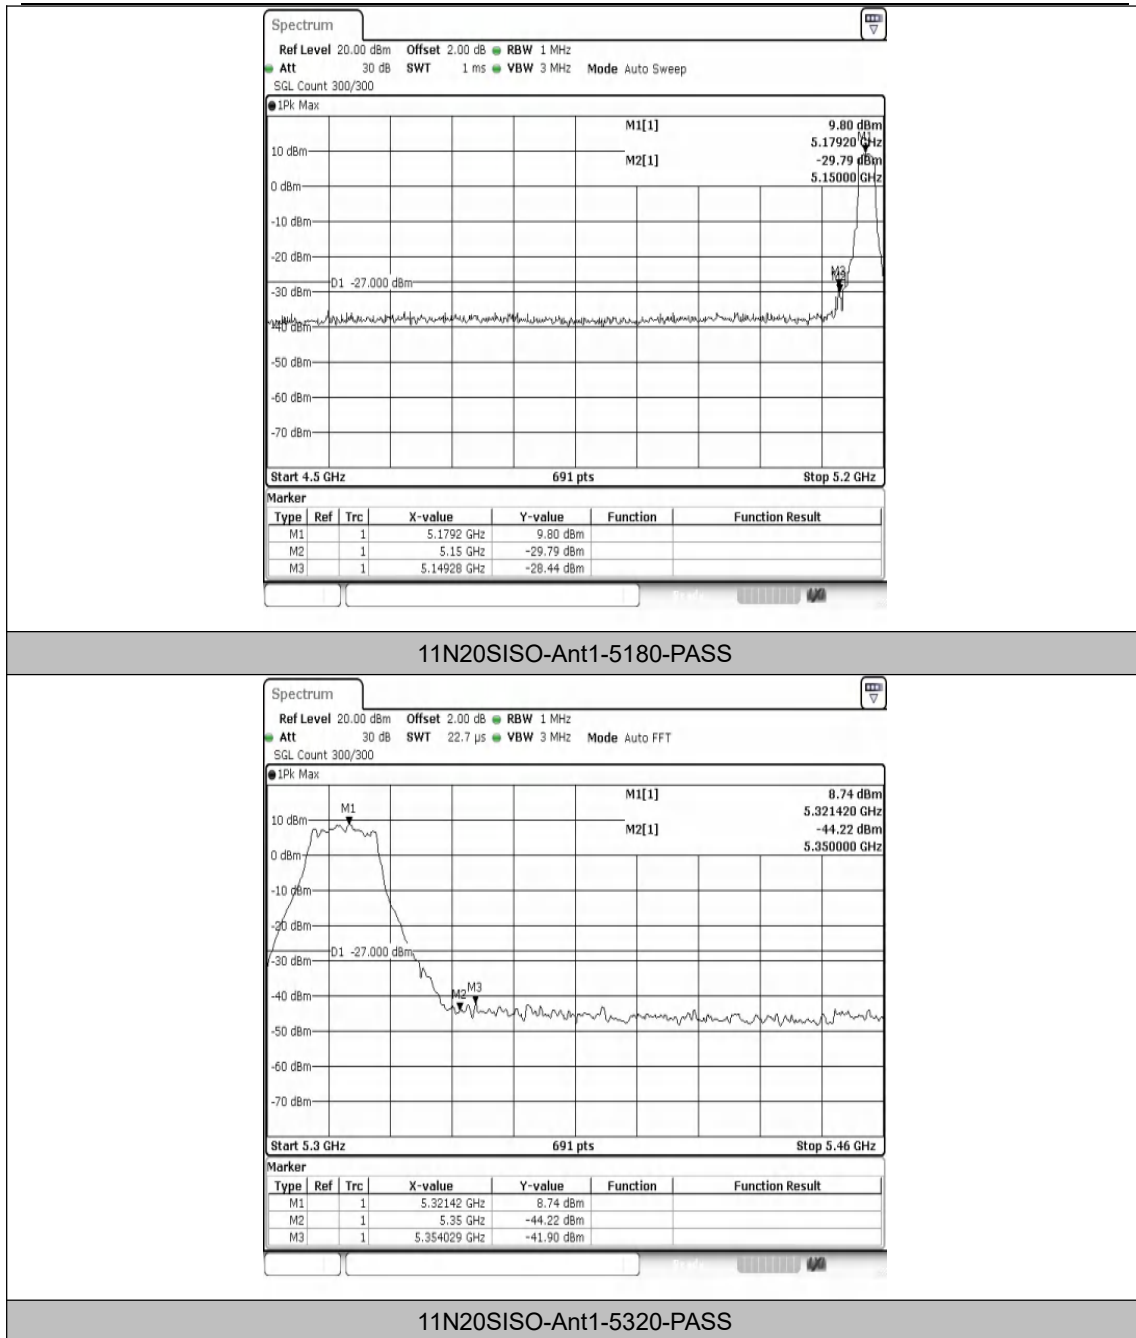


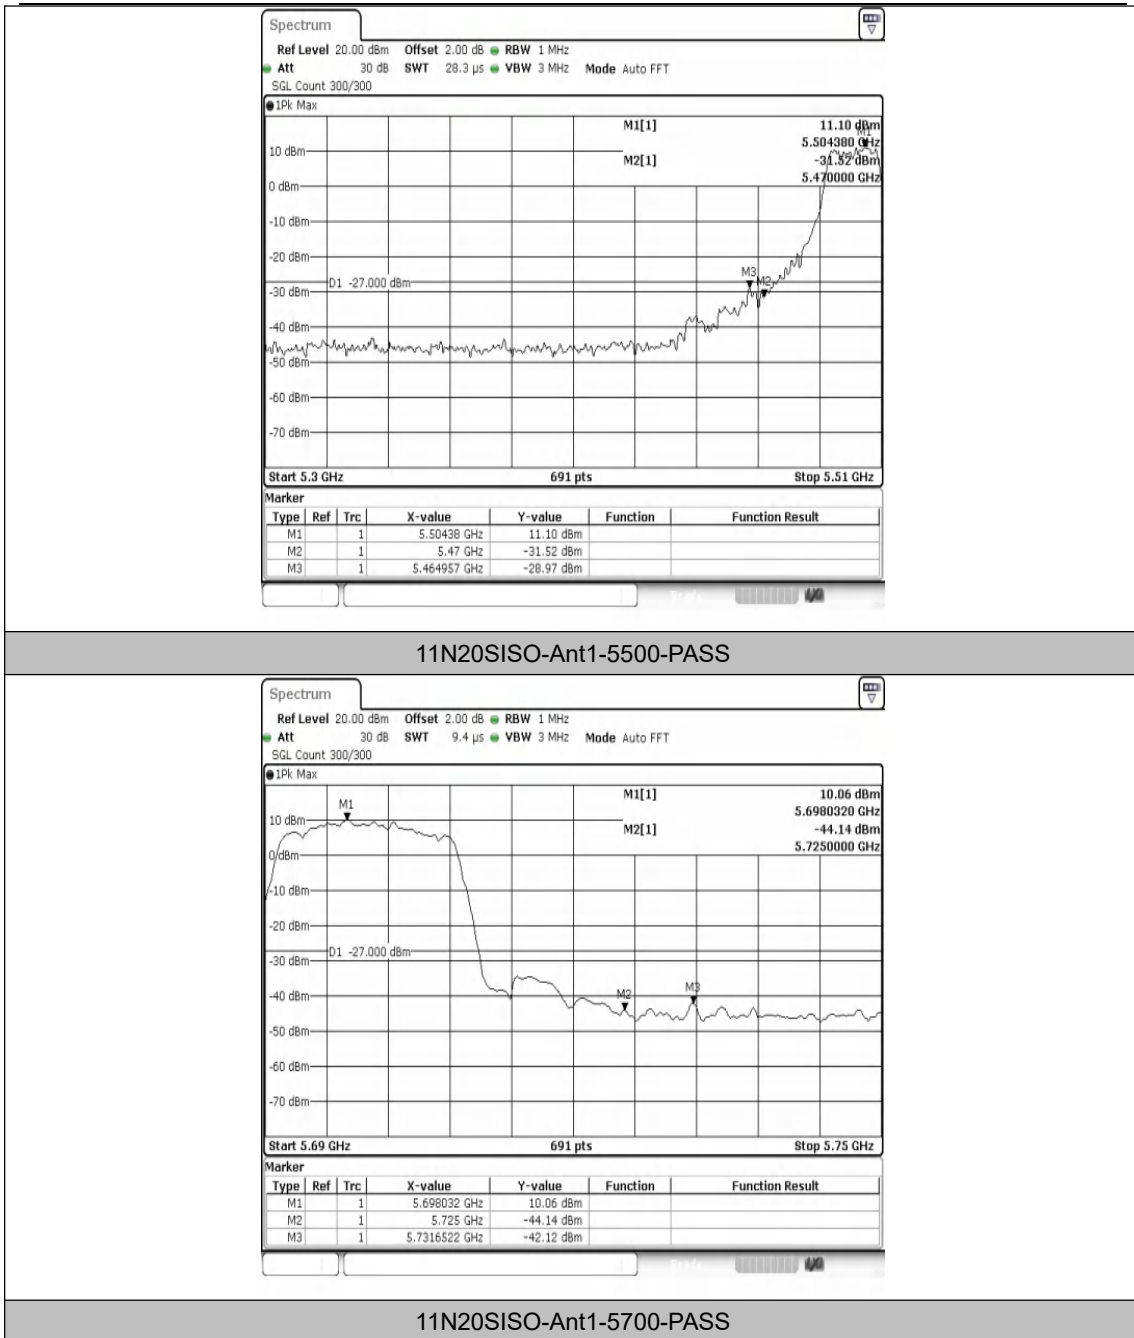


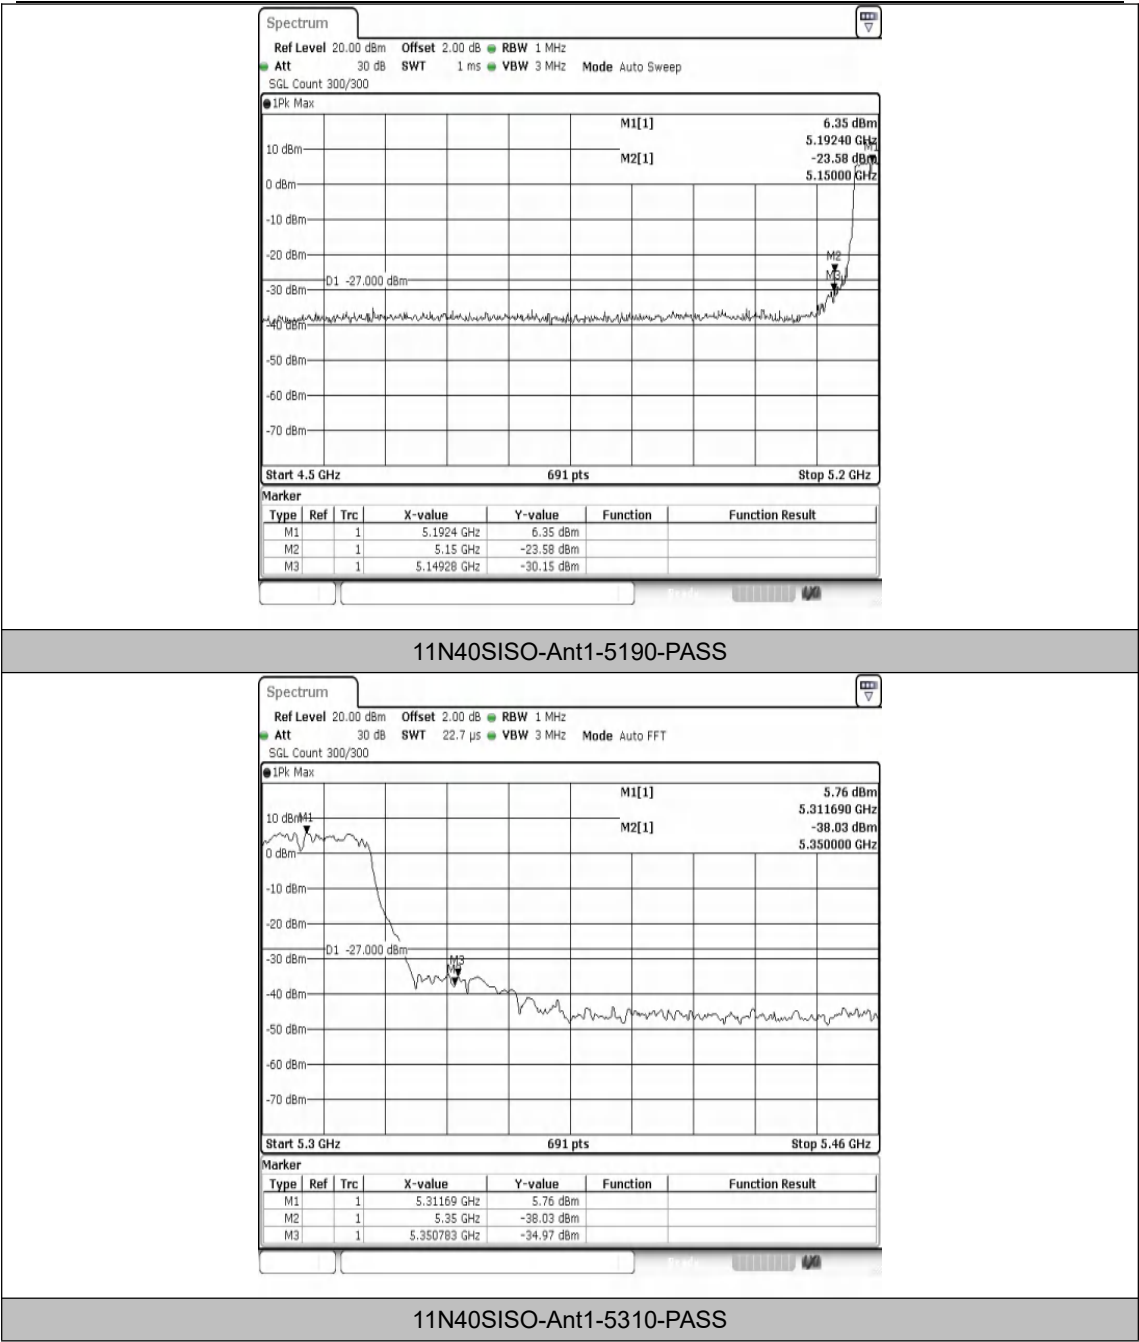


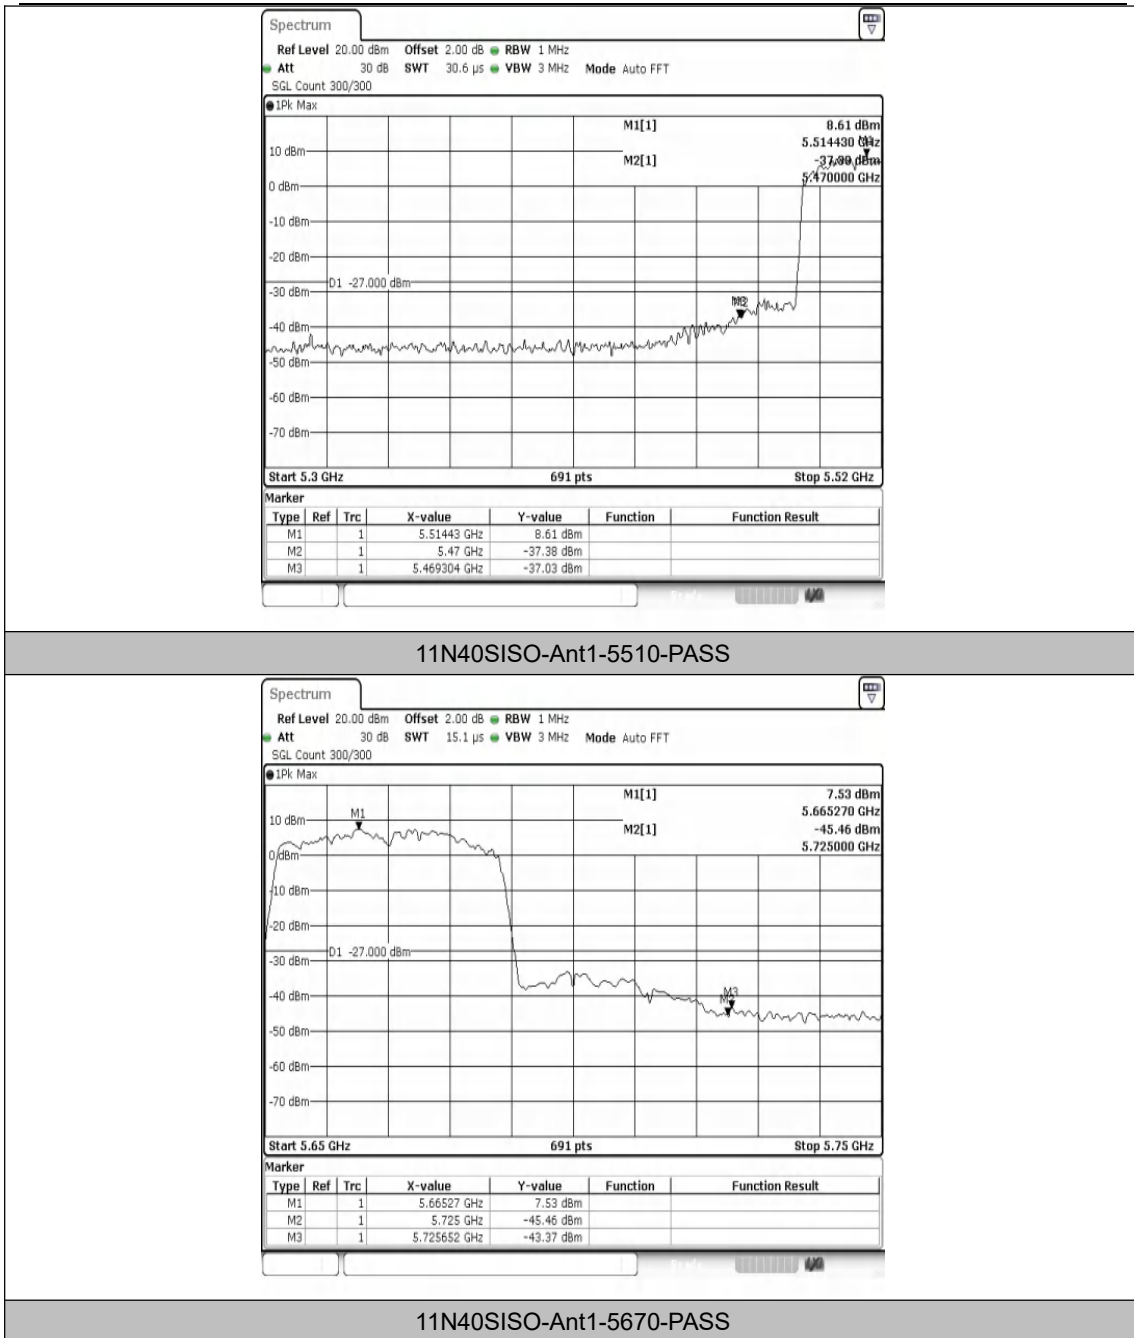


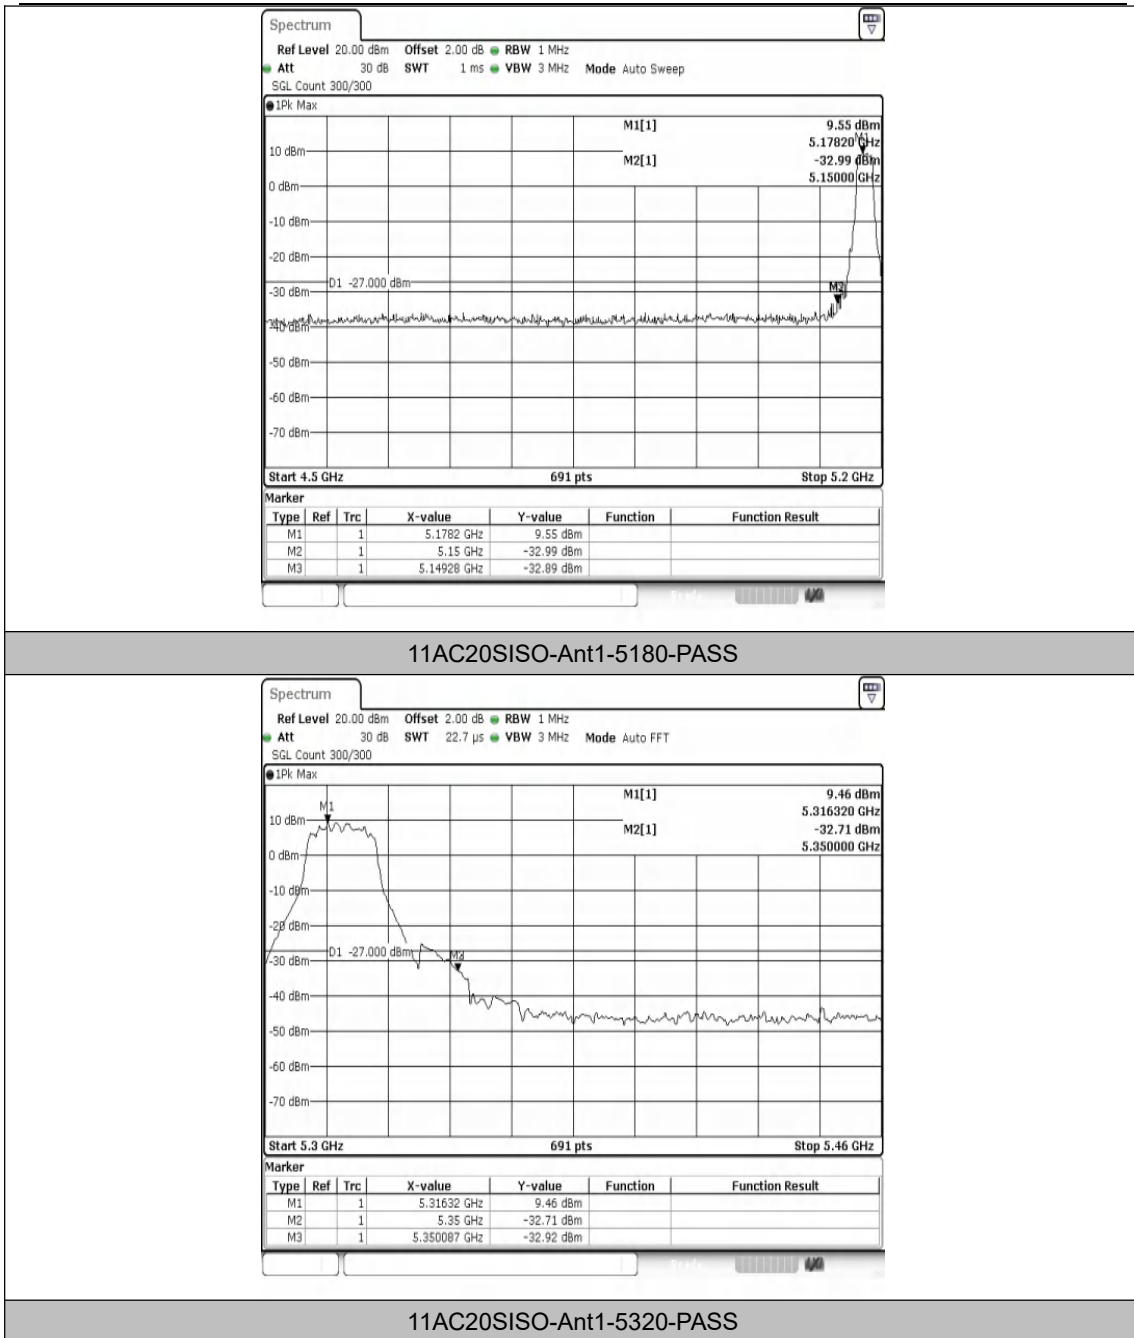


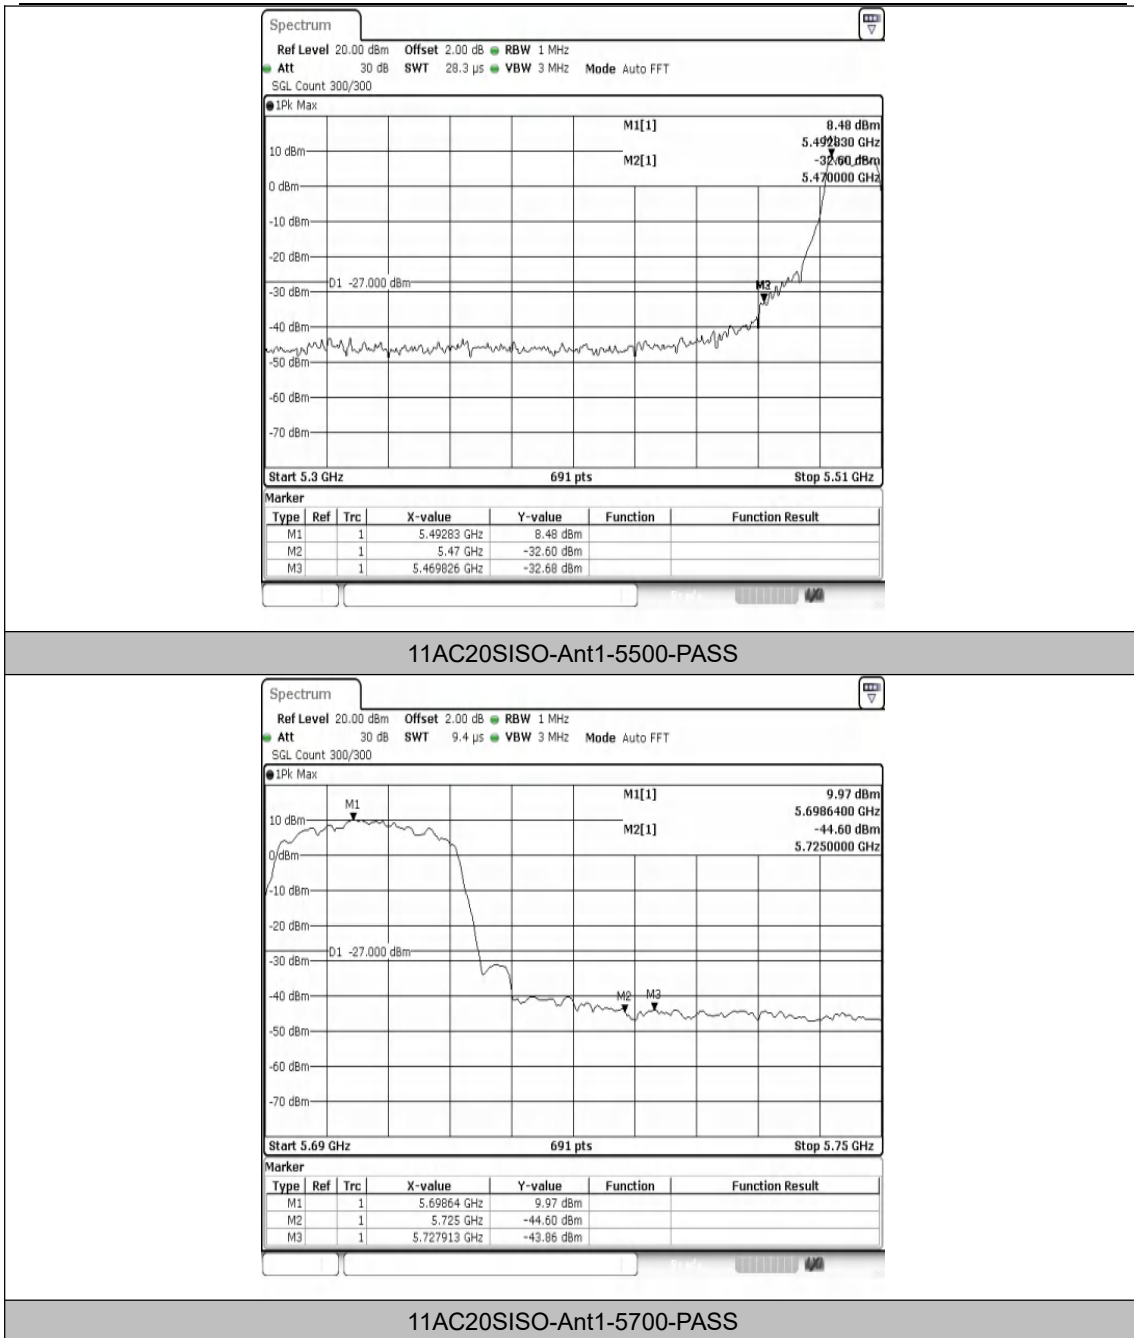


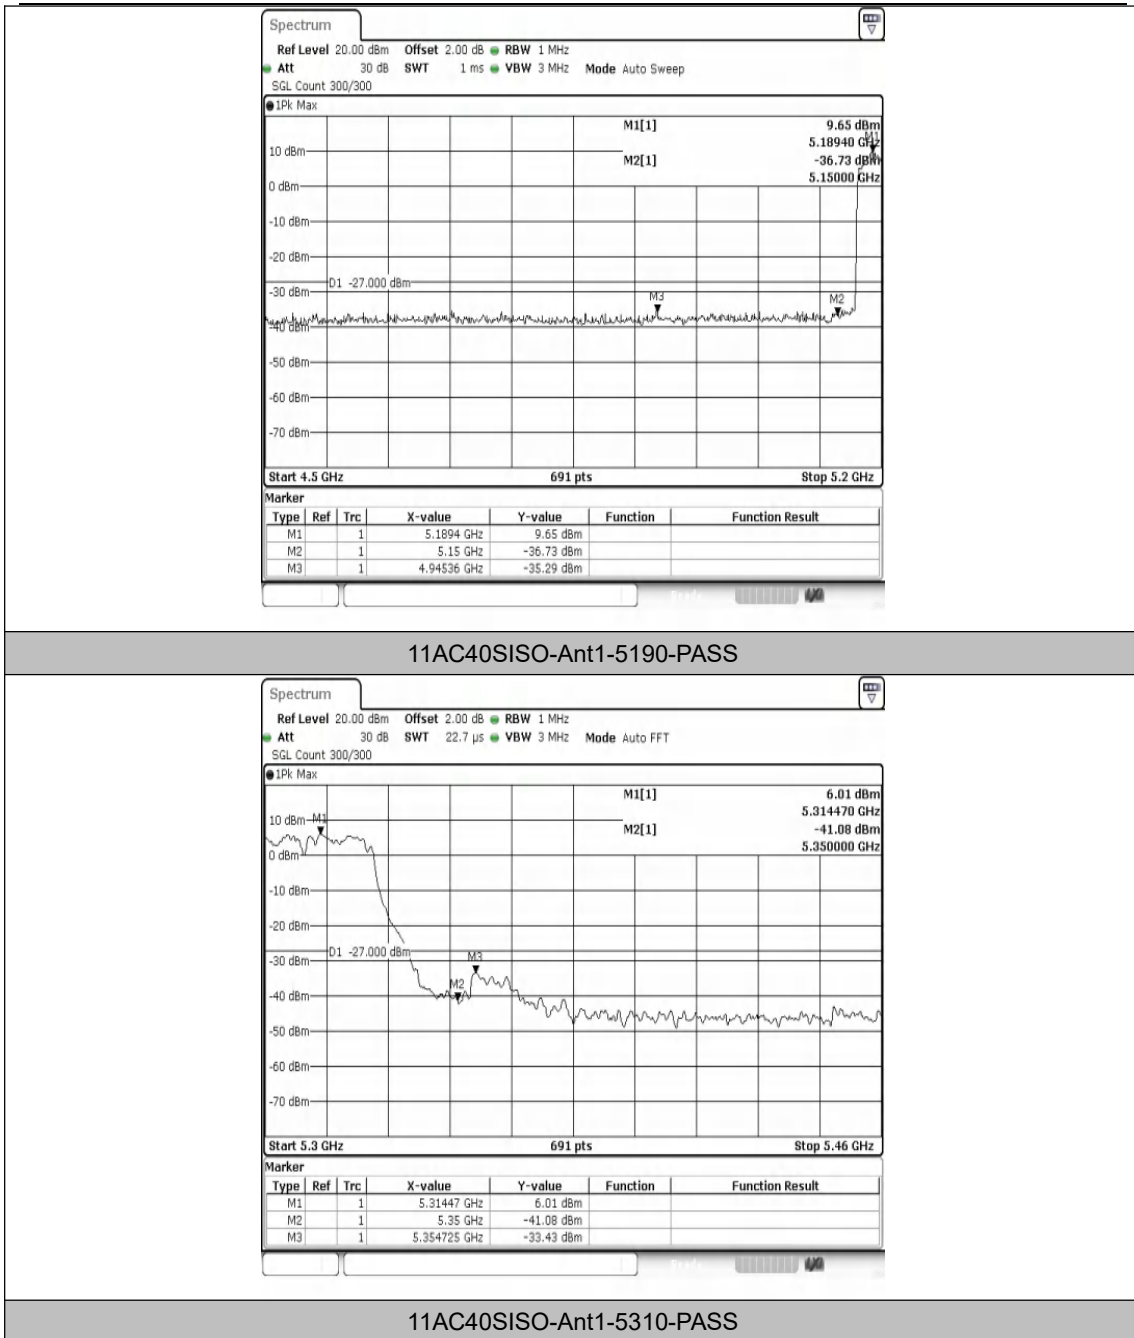

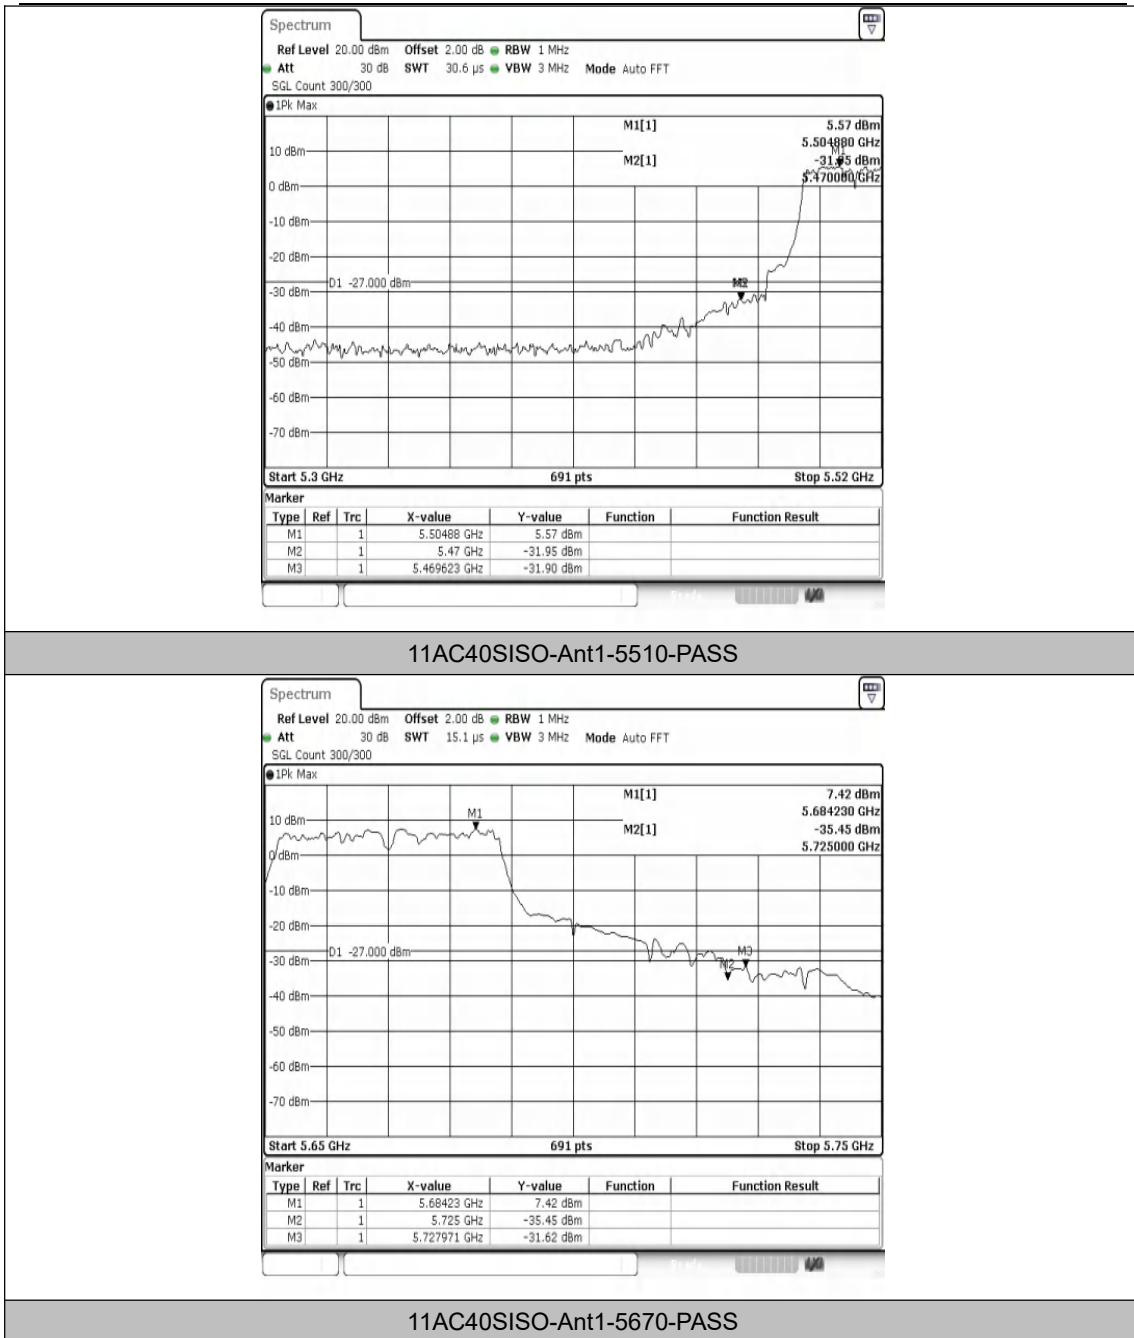

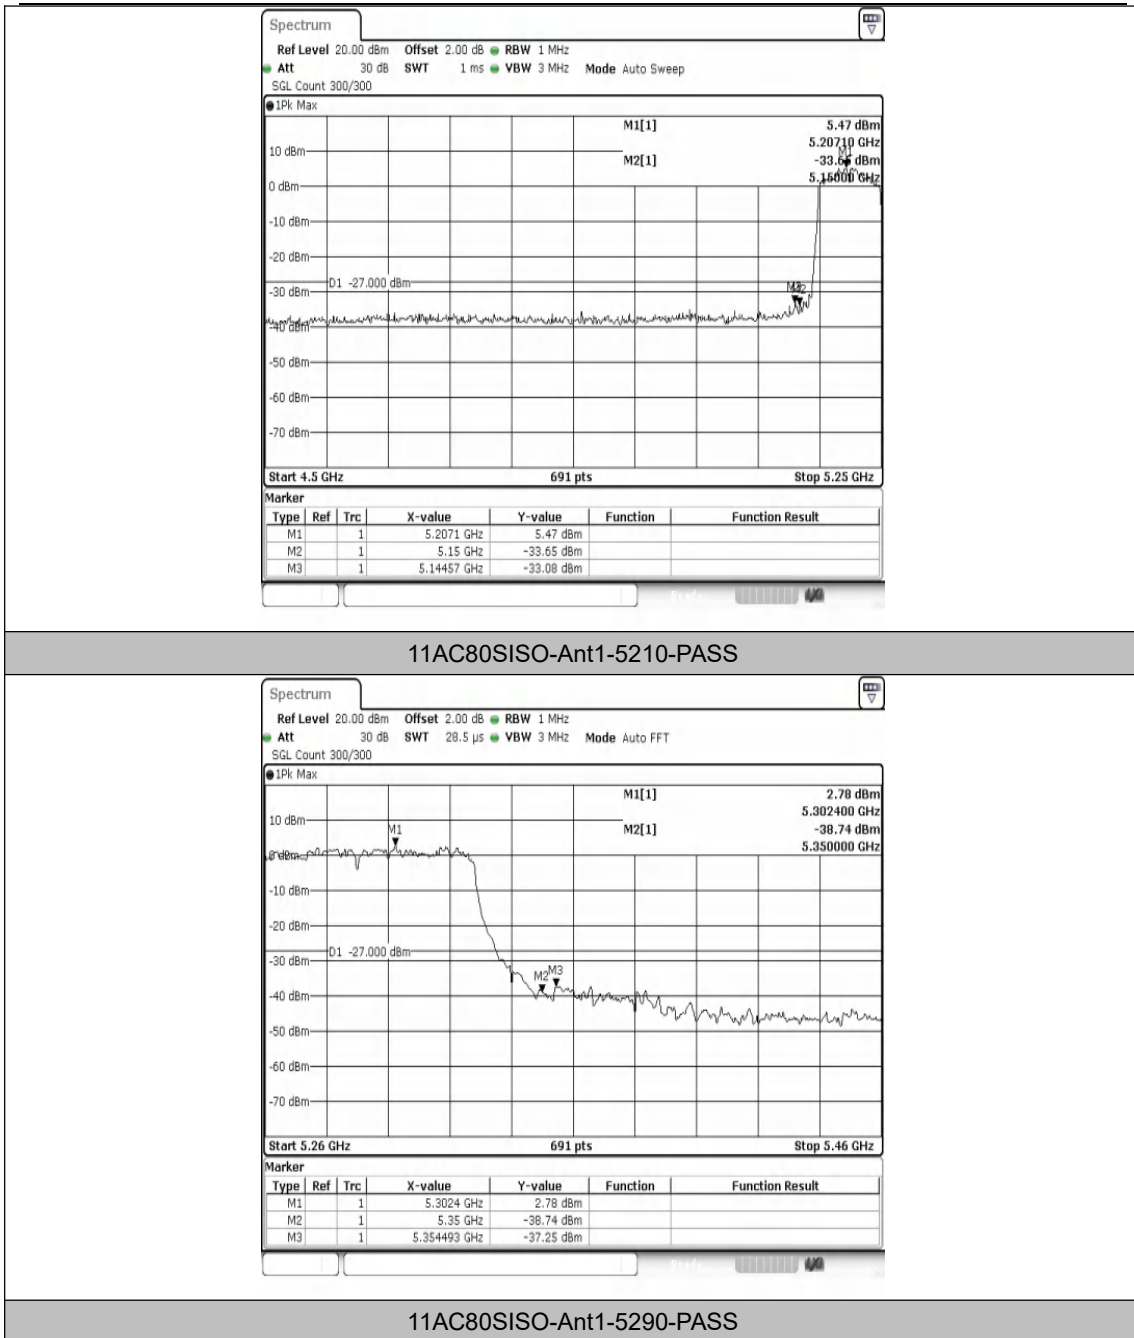

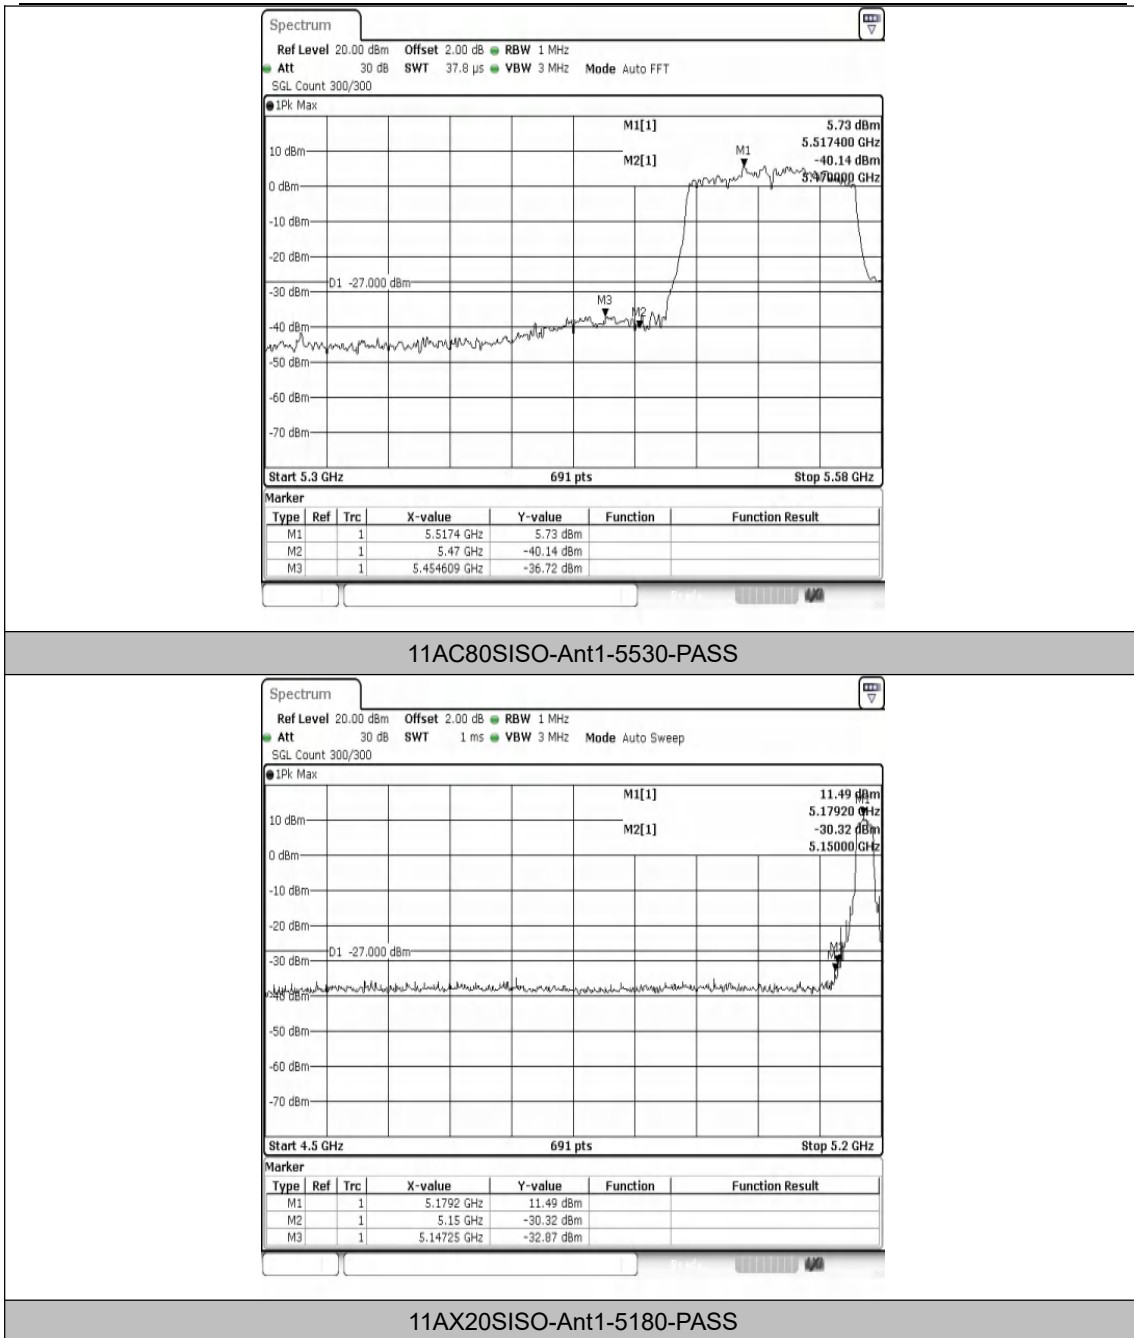


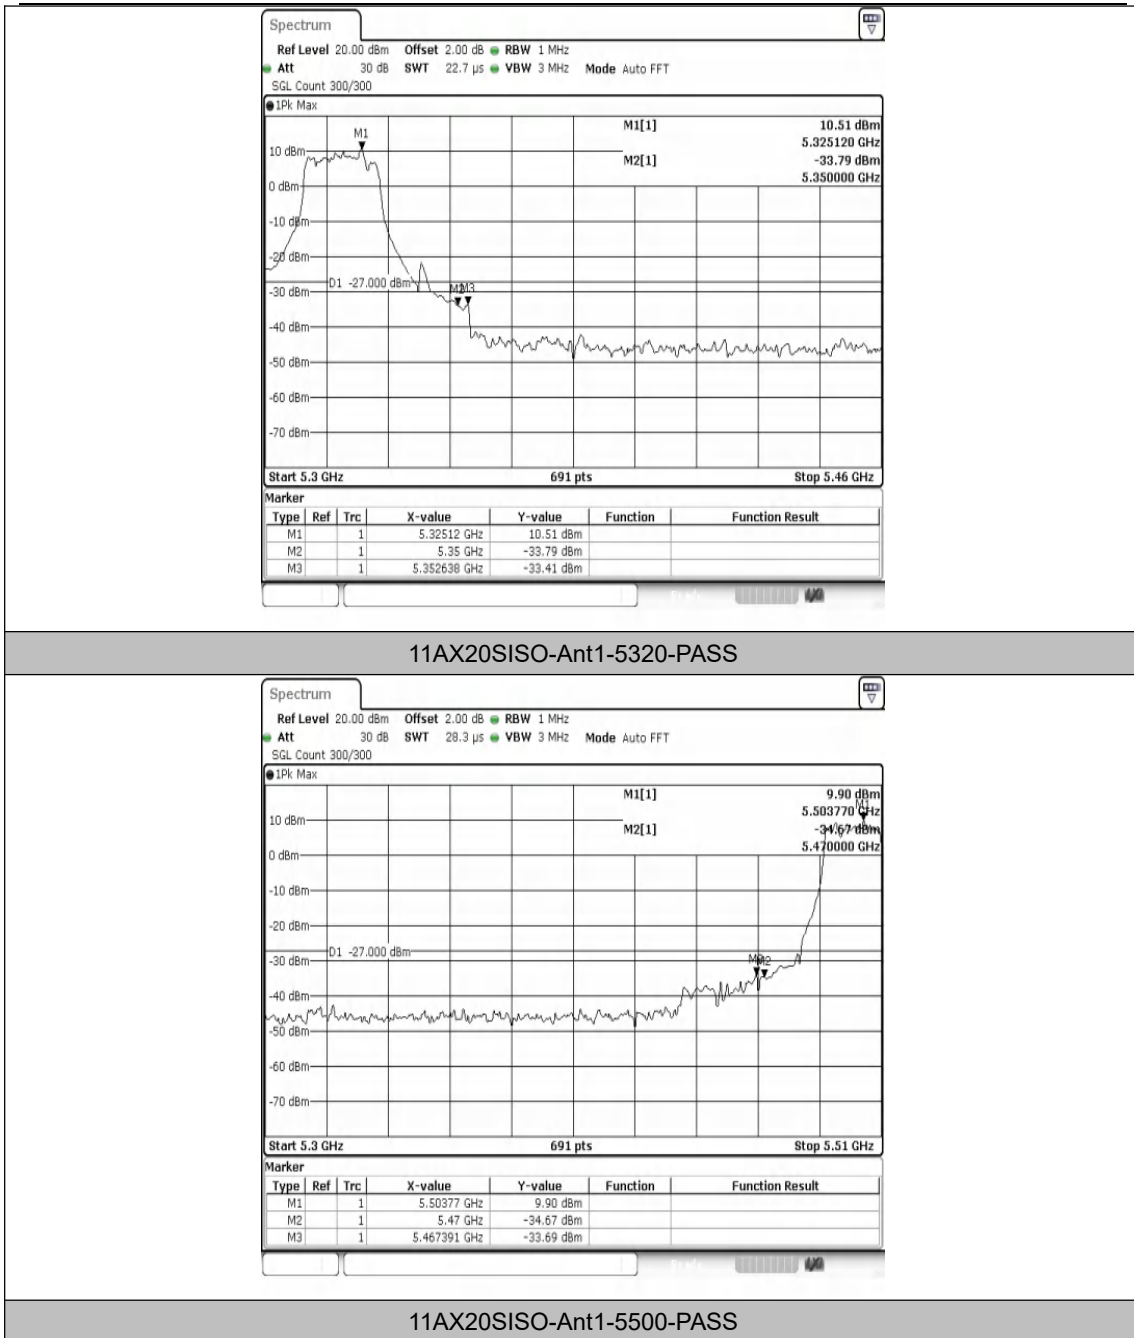


**Shenzhen Anbotek Compliance Laboratory Limited**

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

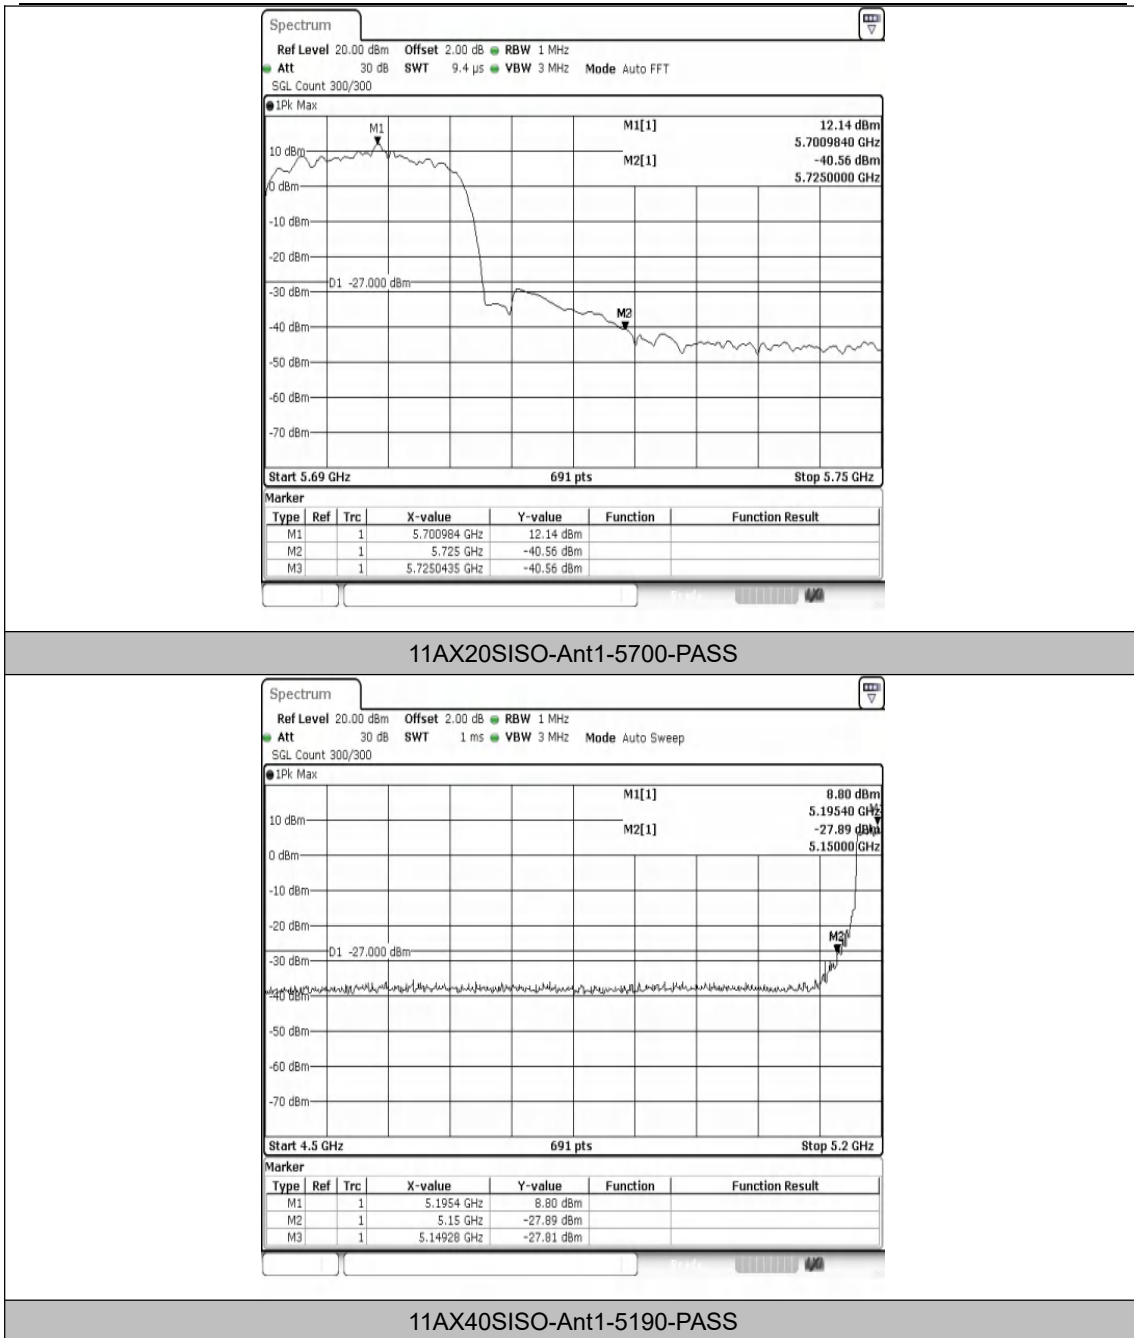


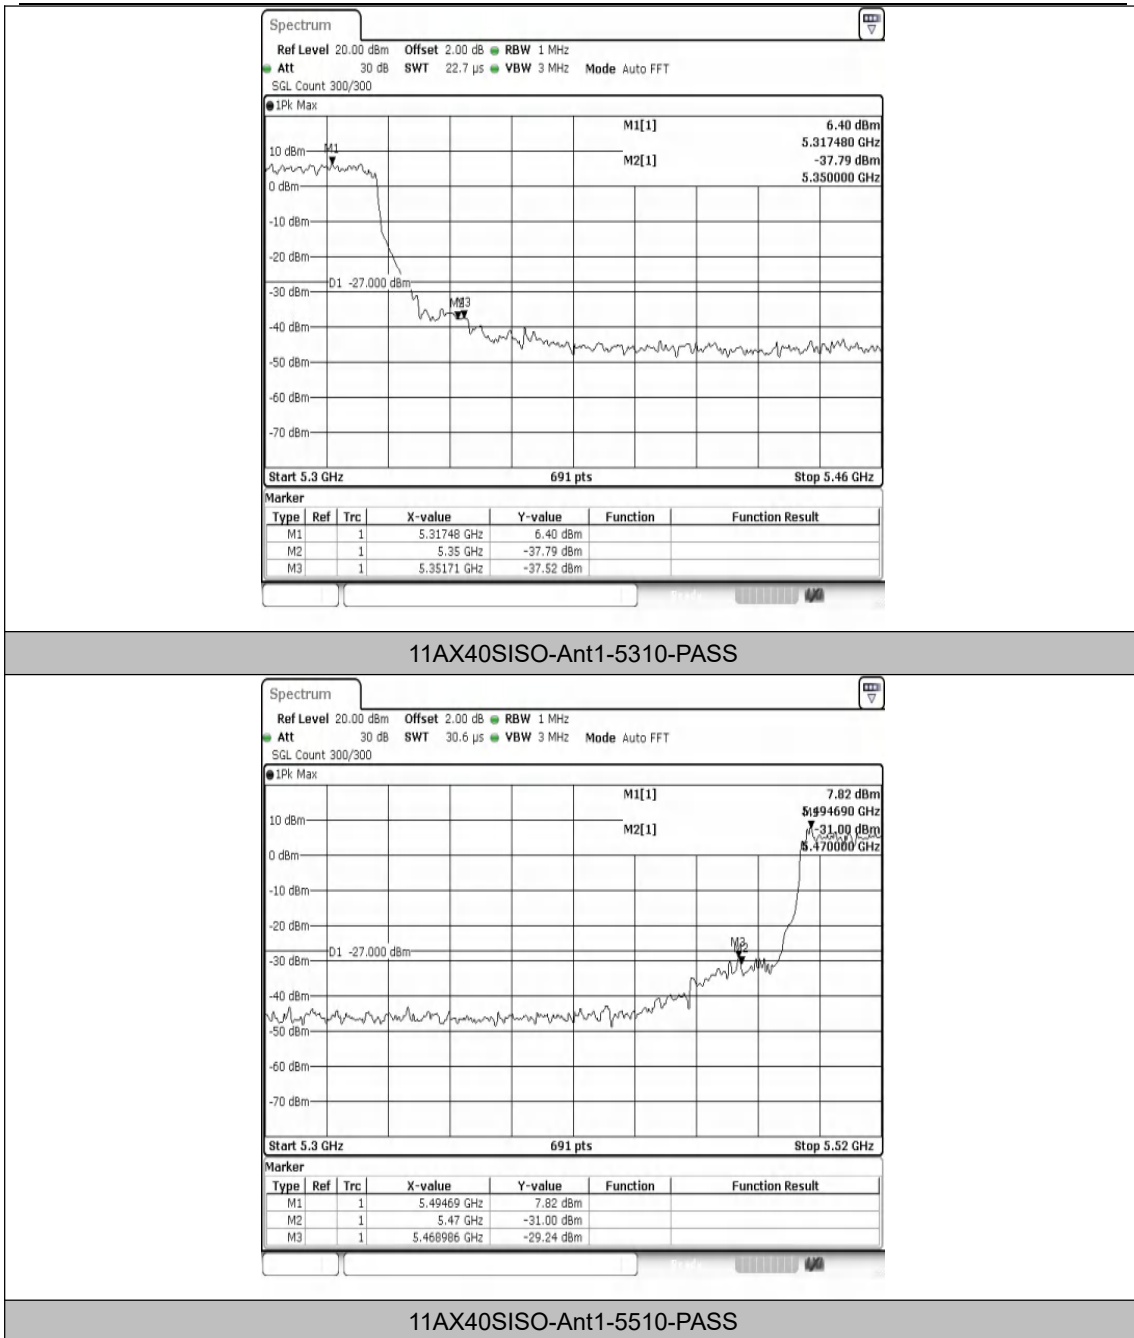


### Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

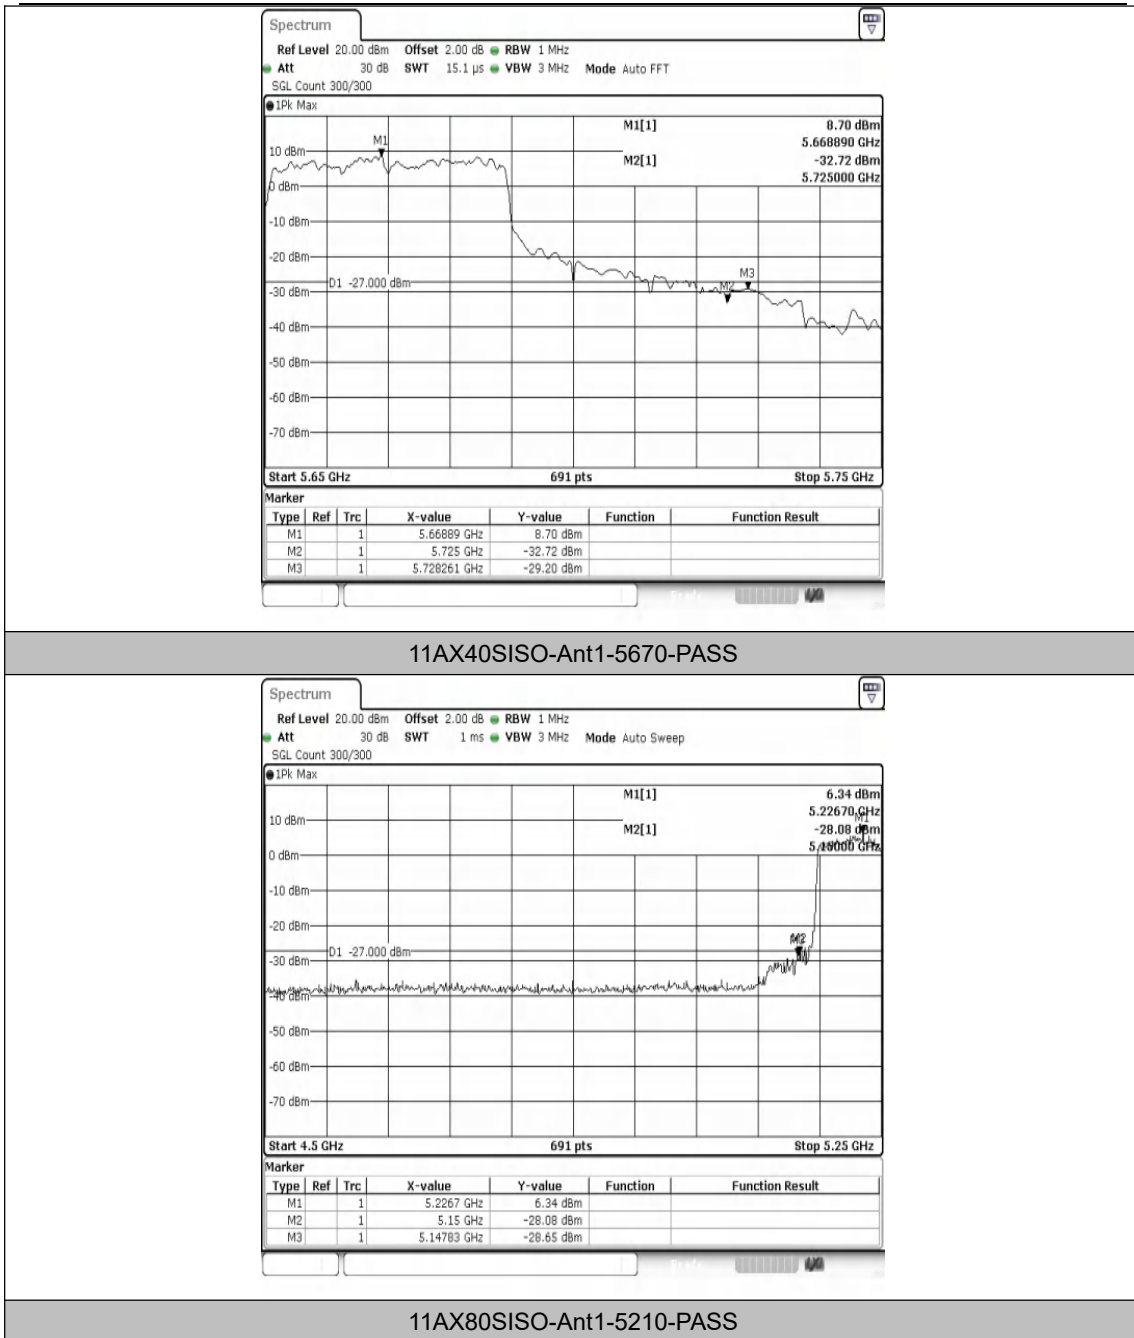


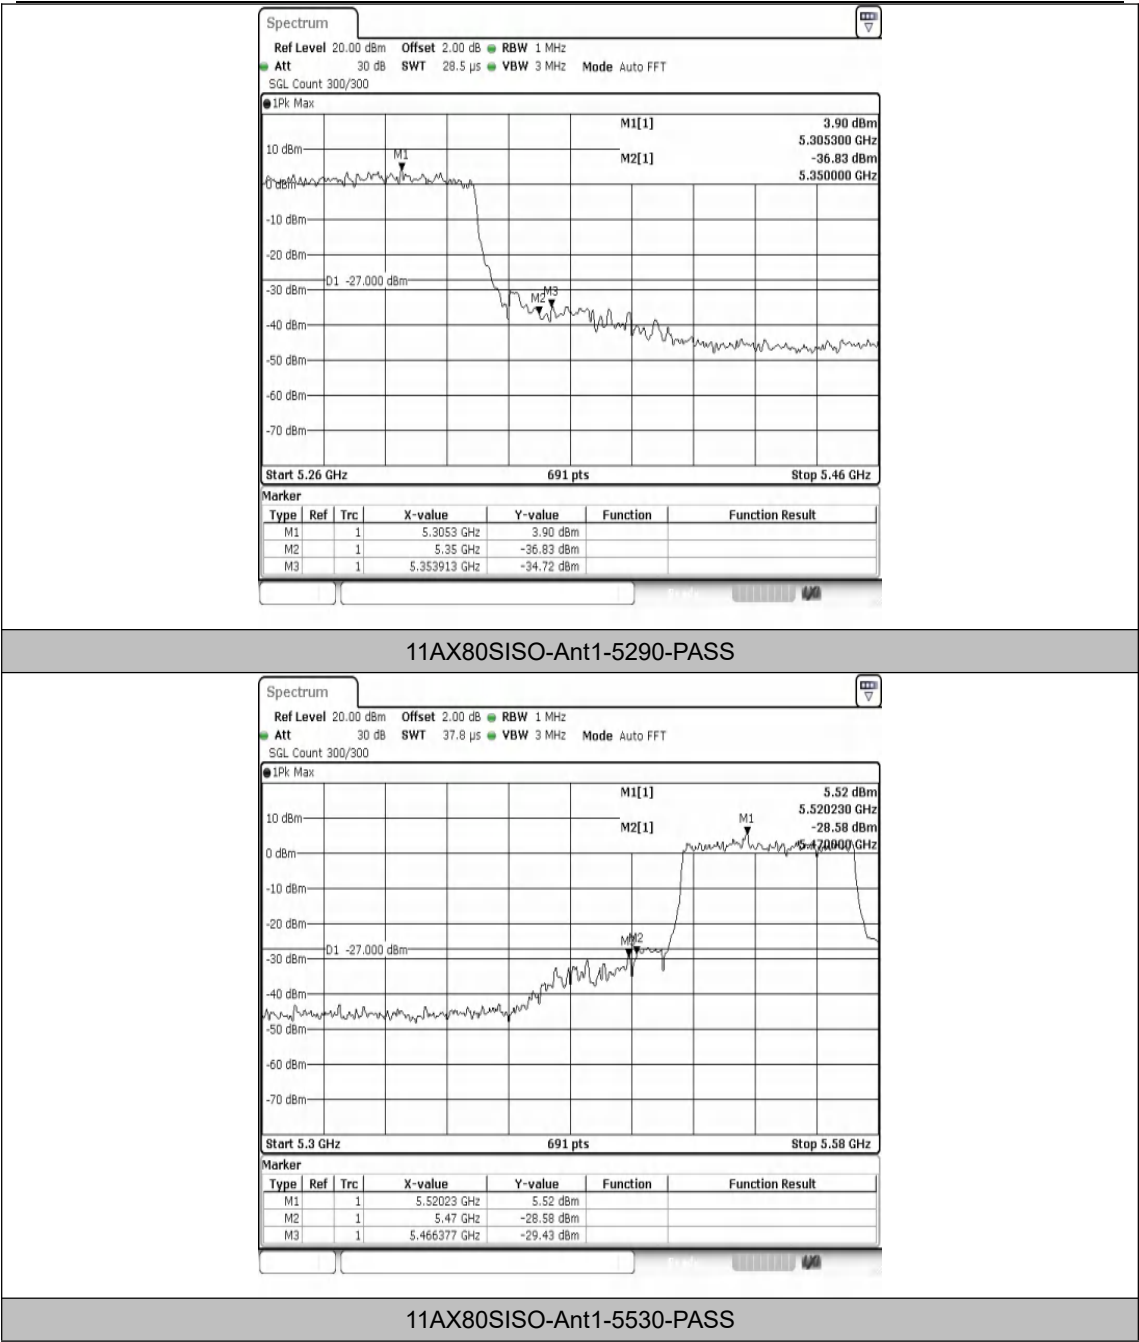


## Test Graphs B4

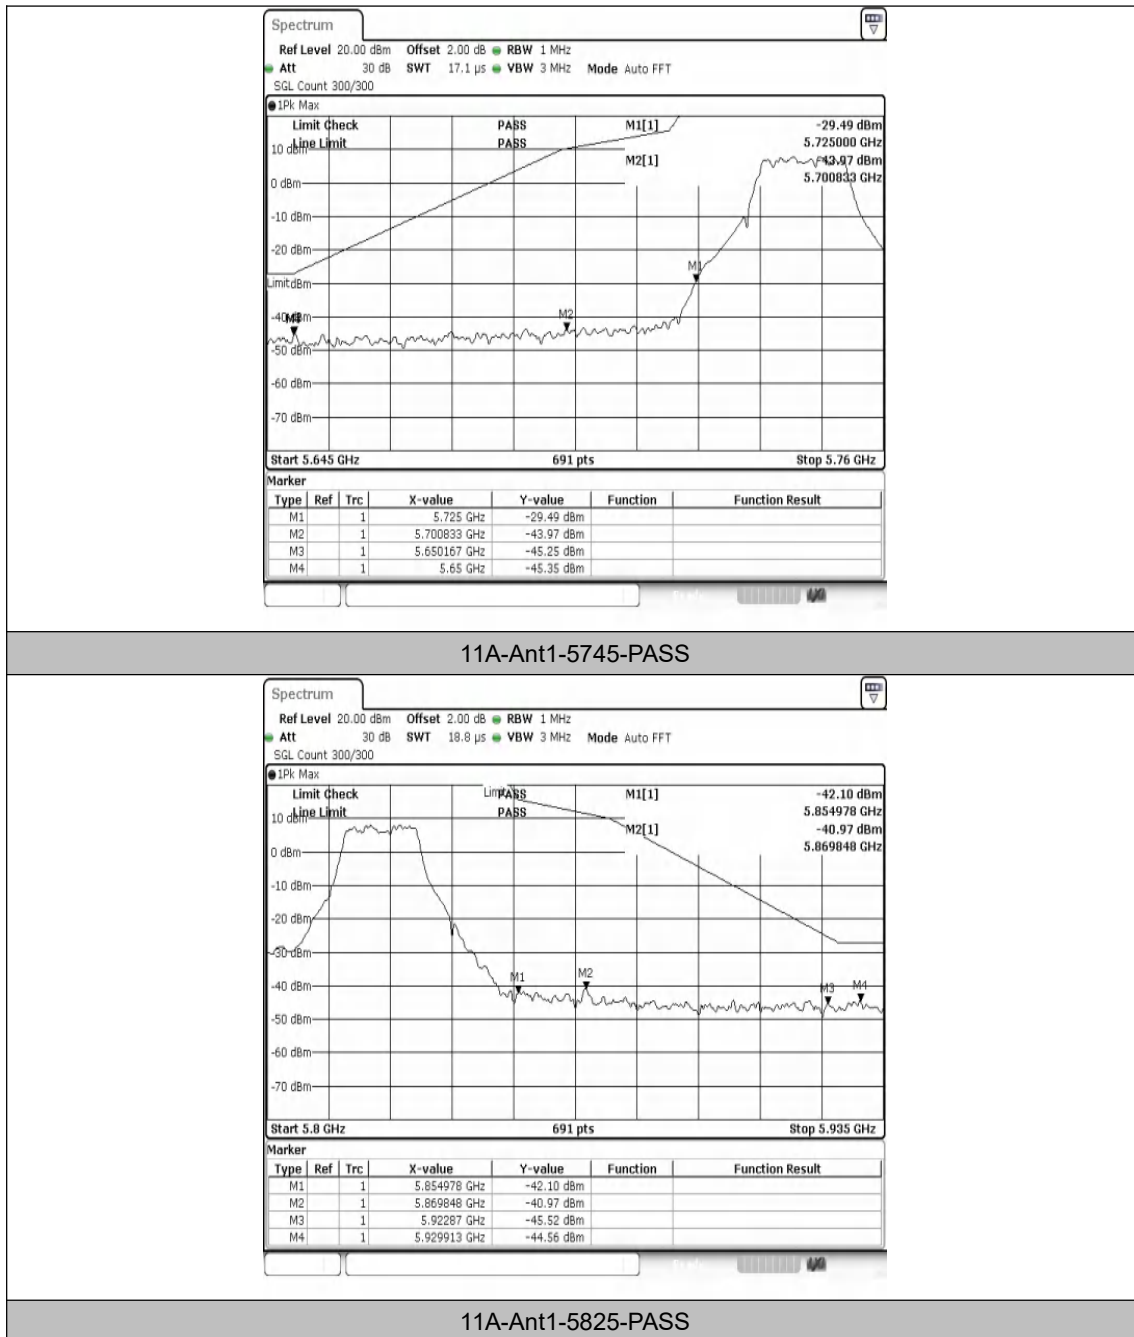


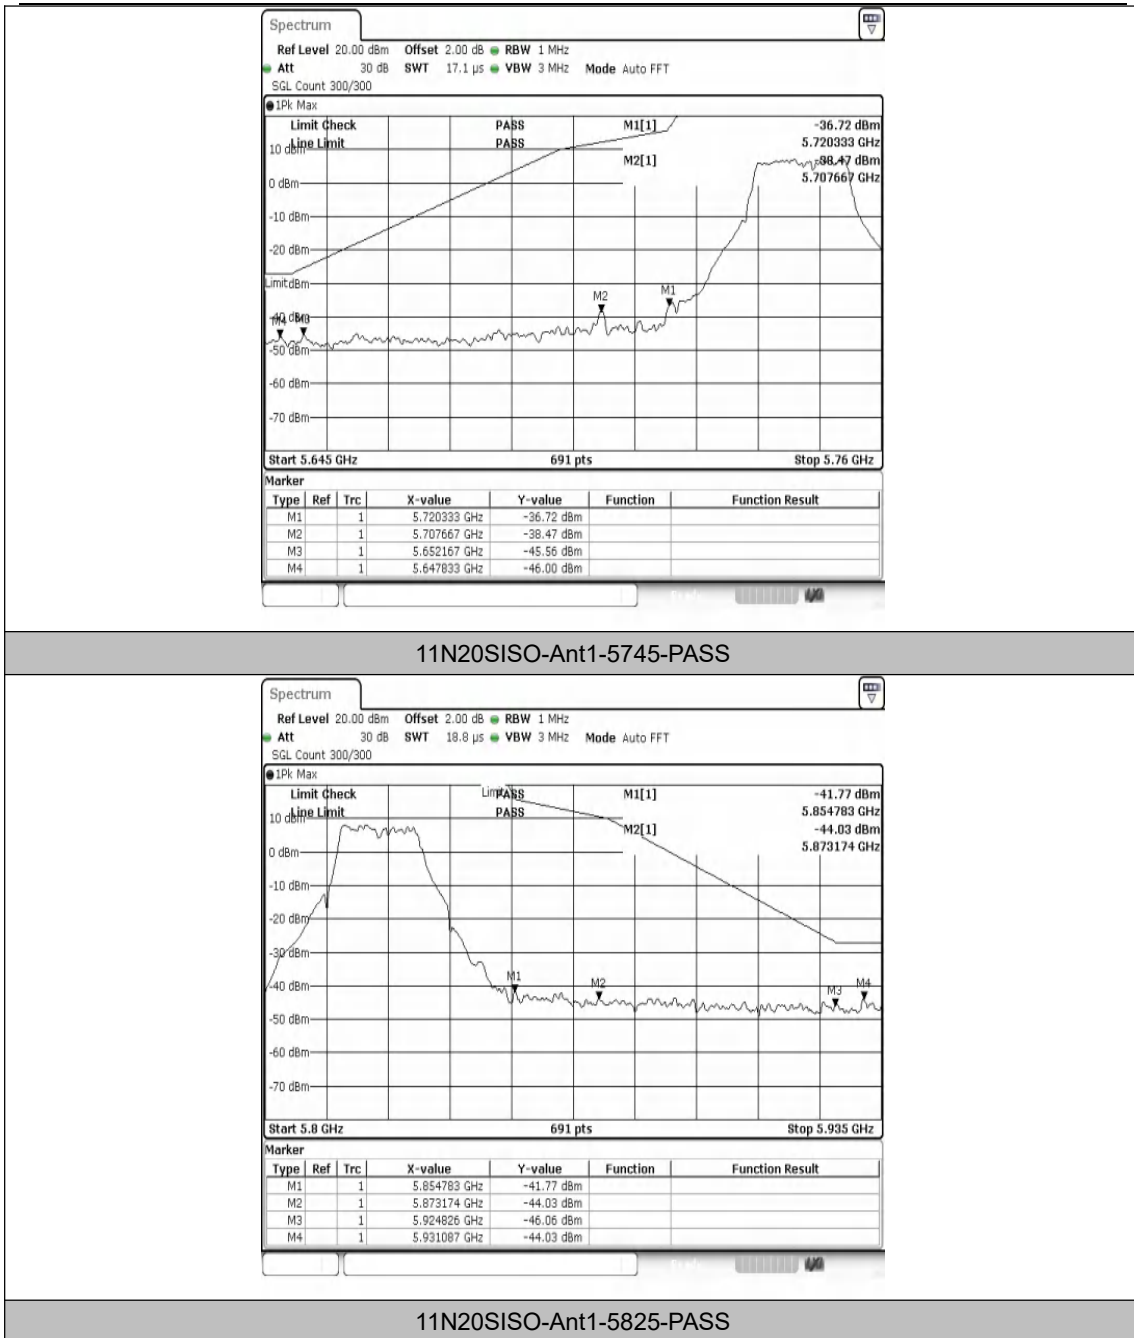

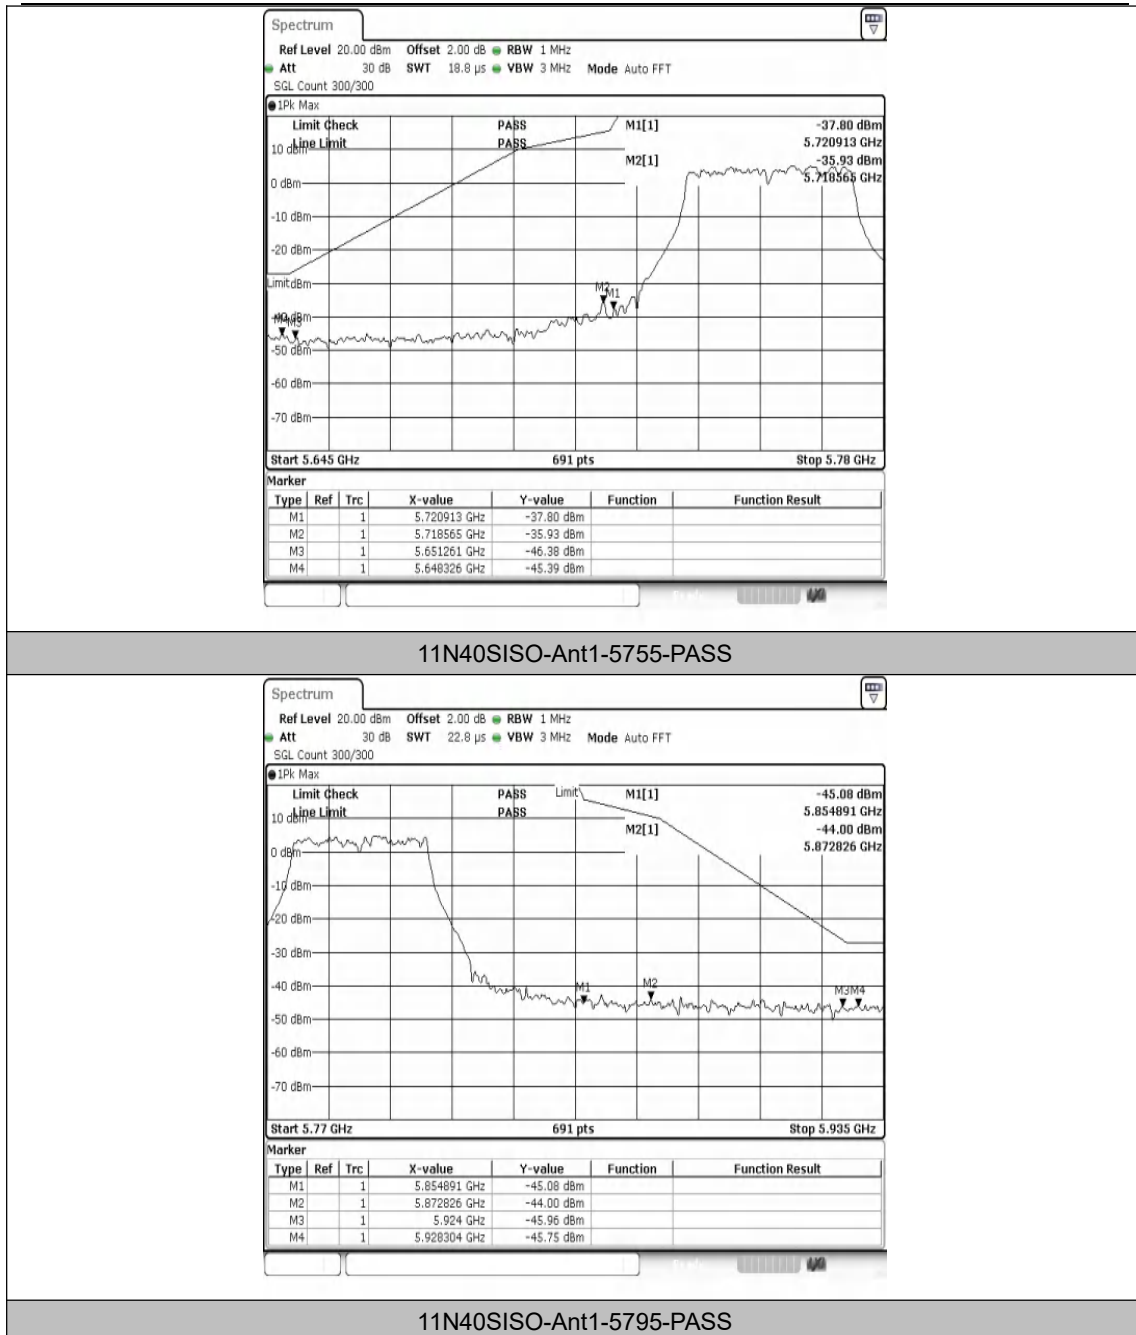


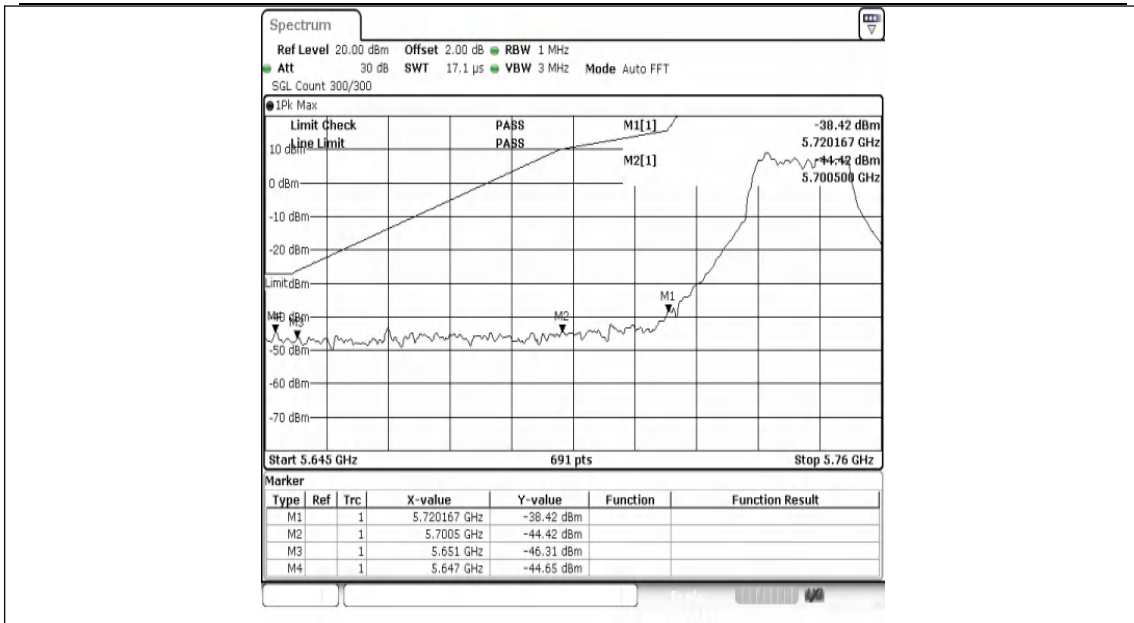

11AC20SISO-Ant1-5745-PASS

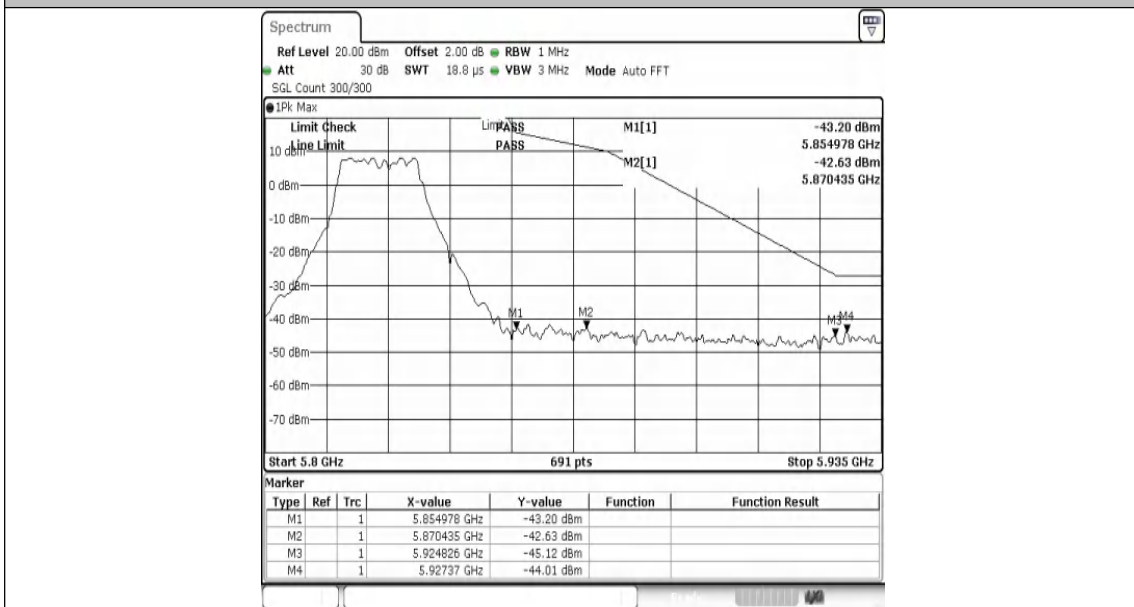


11AC20SISO-Ant1-5825-PASS

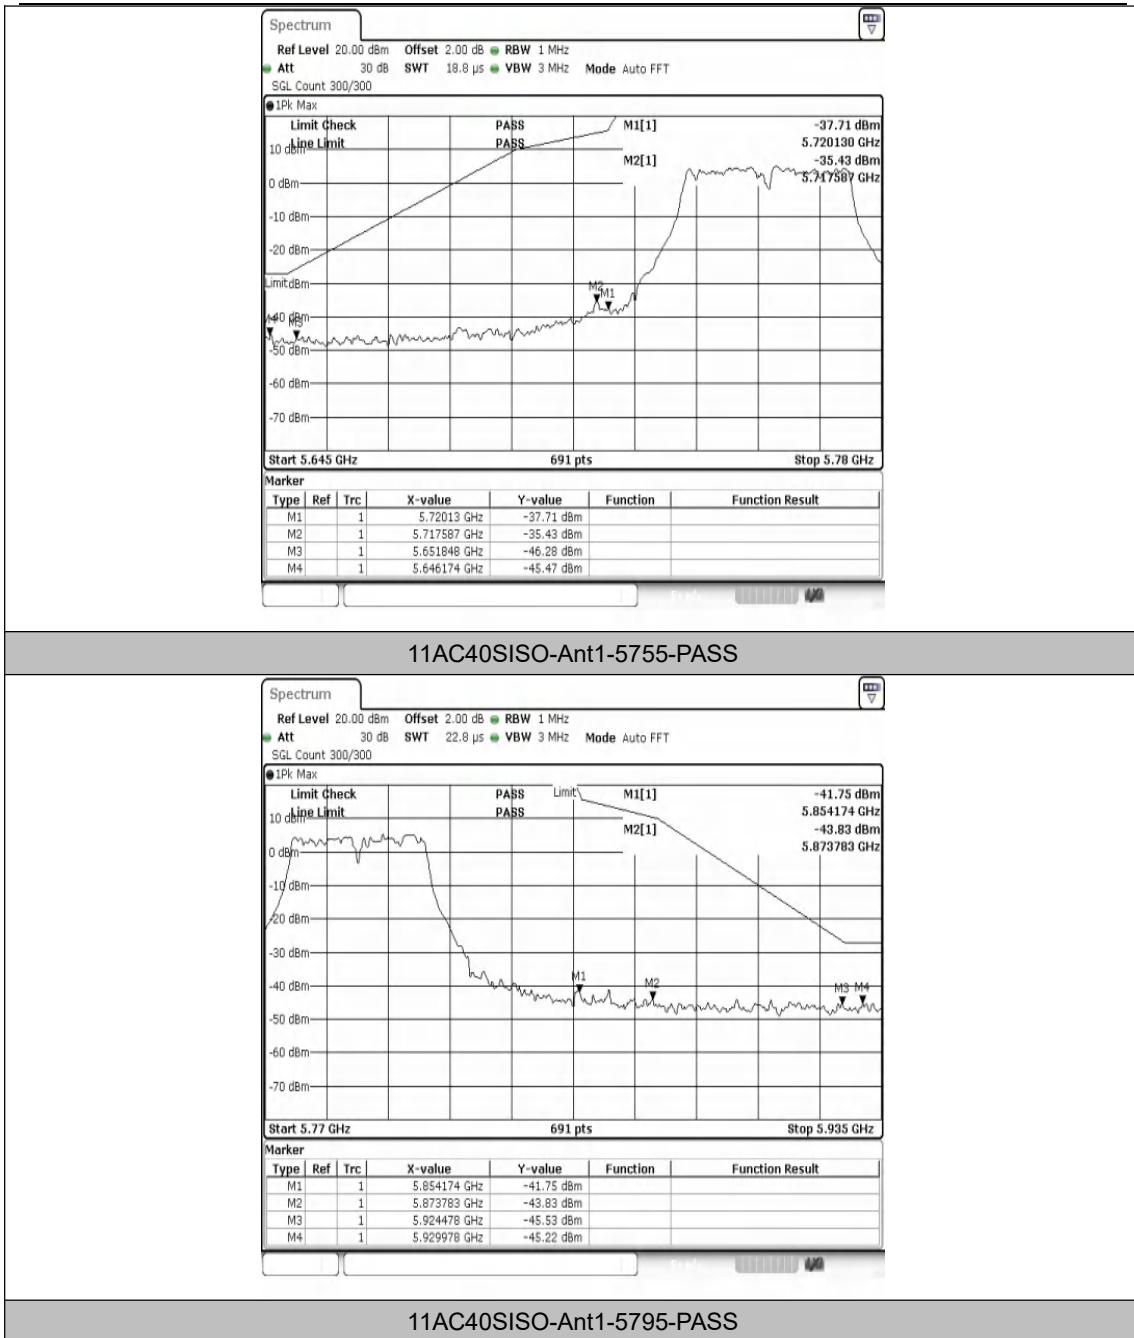

**Shenzhen Anbotek Compliance Laboratory Limited**

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

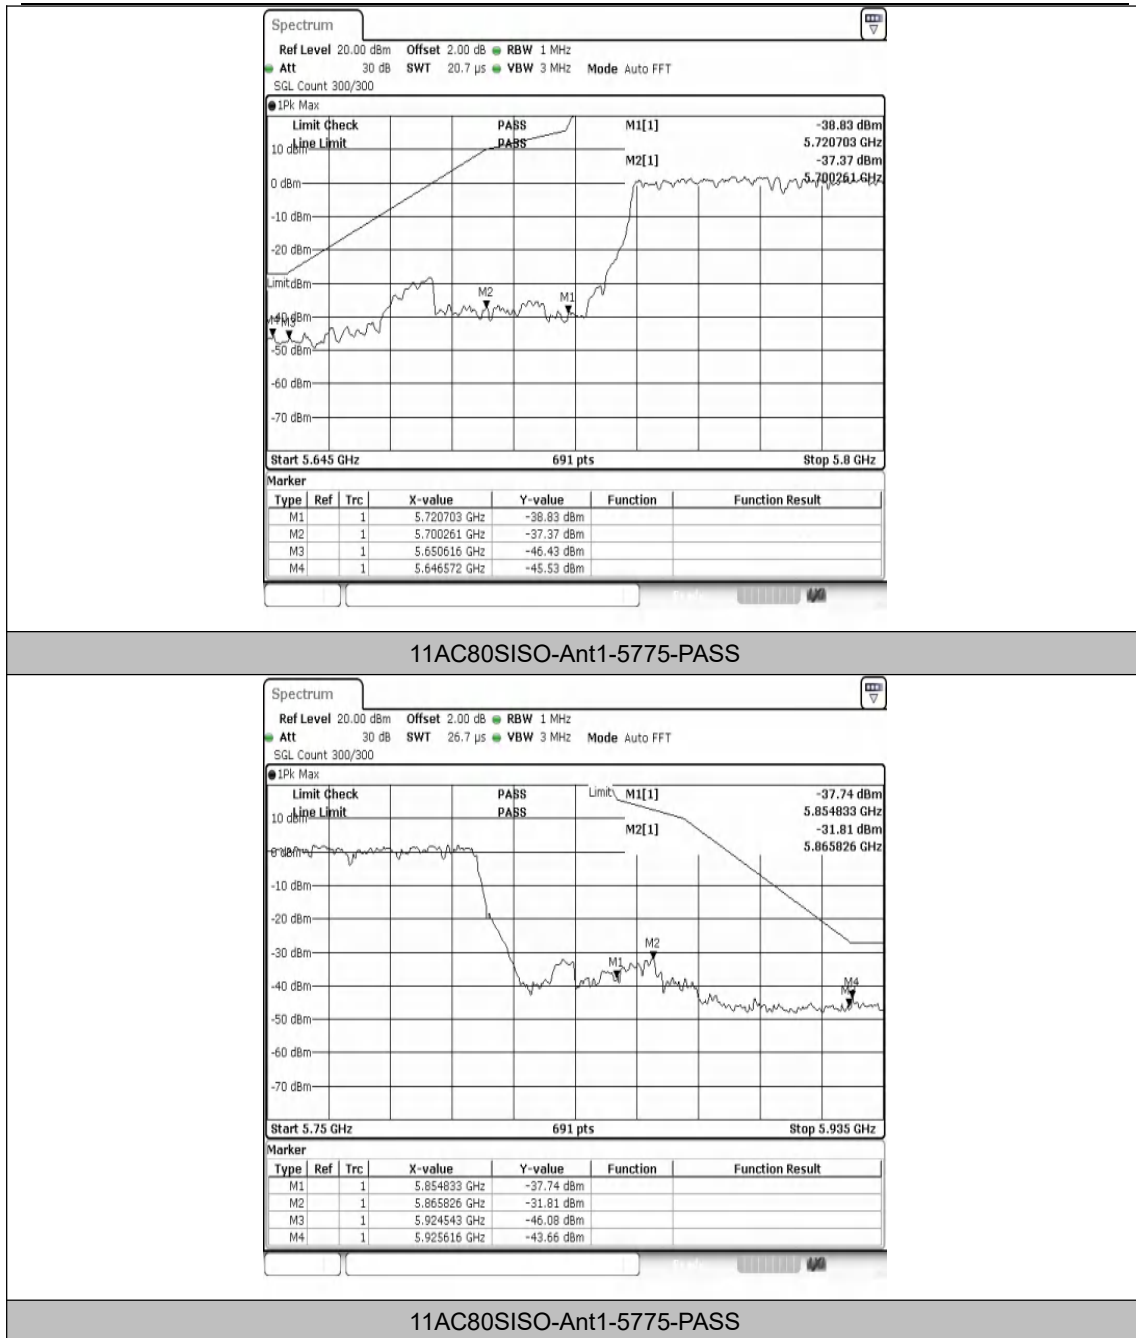



**Shenzhen Anbotek Compliance Laboratory Limited**

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

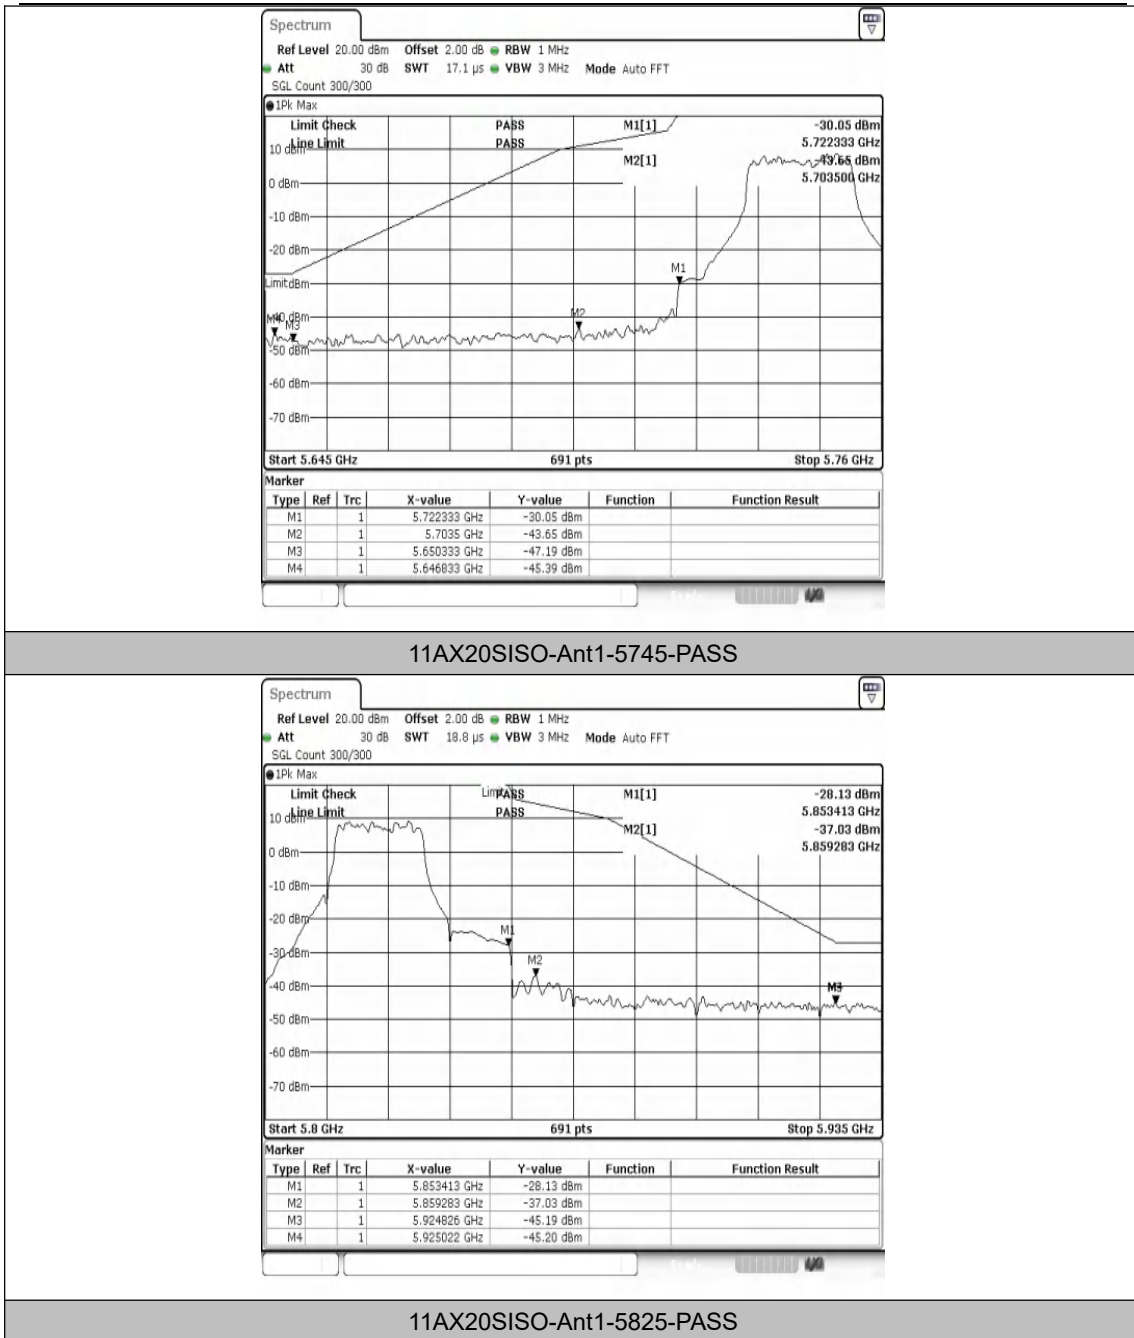

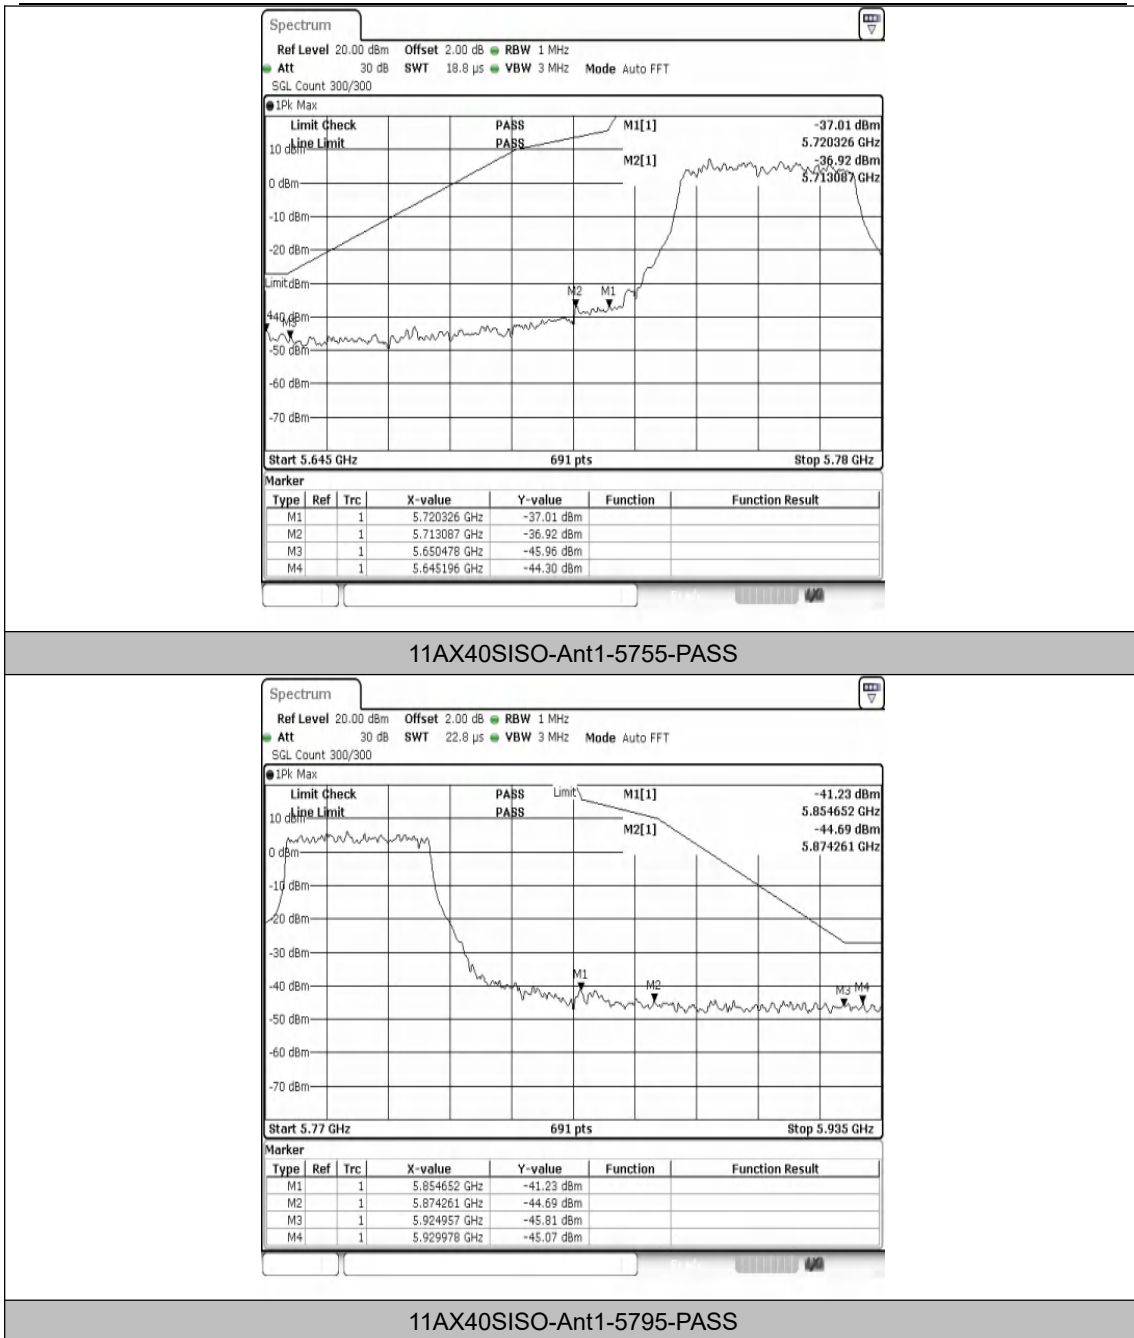

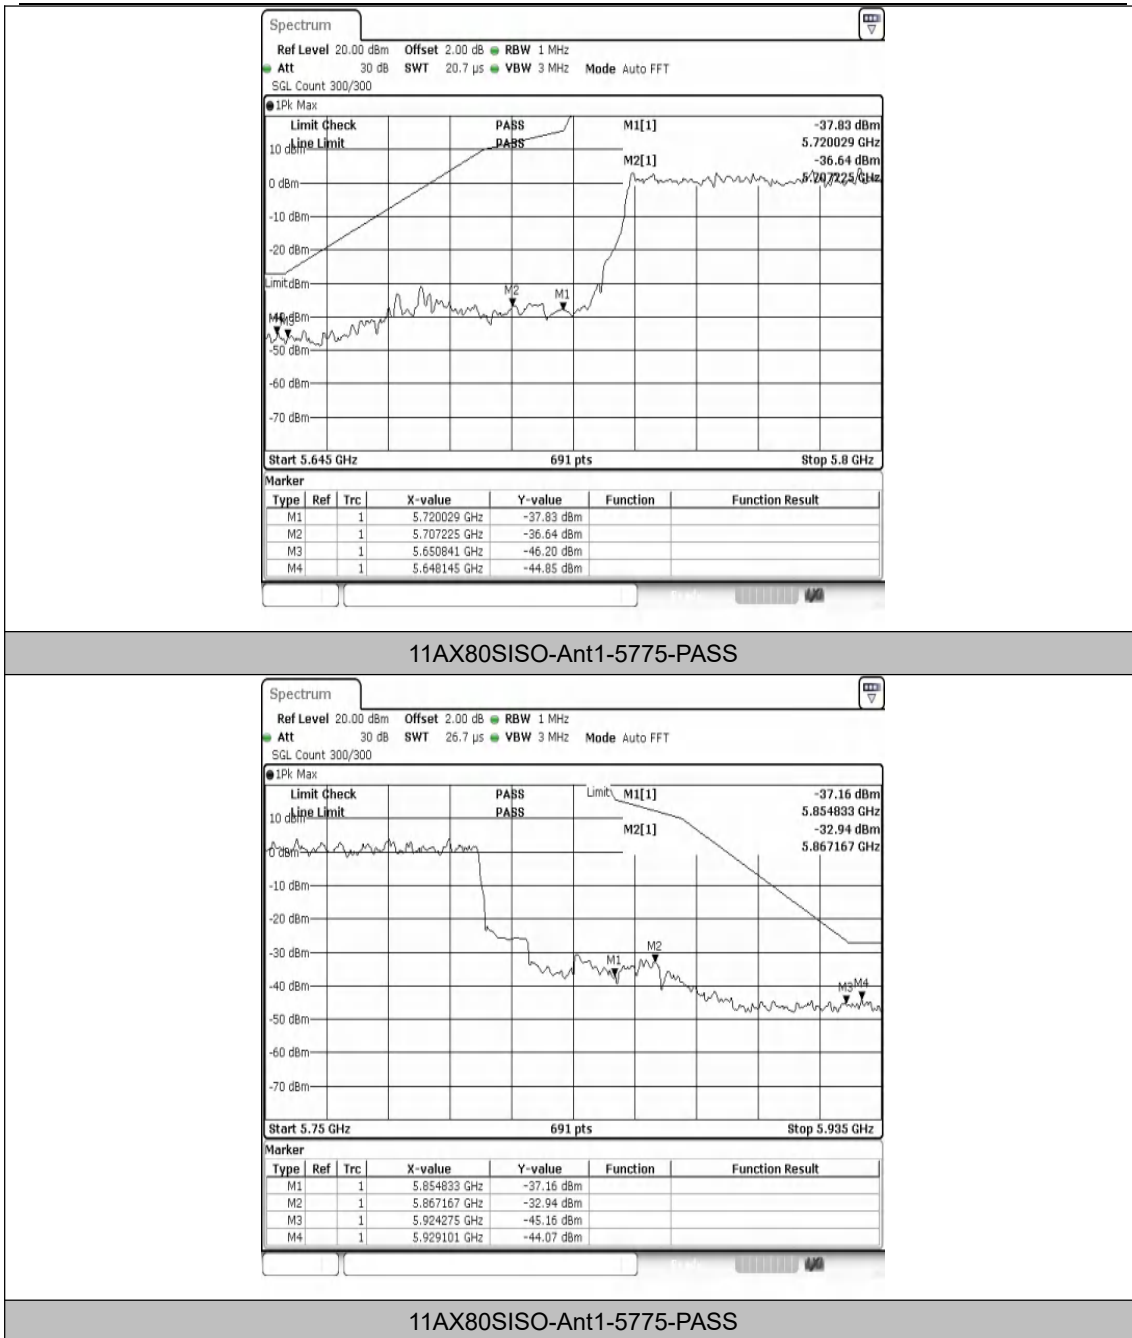


---

## Appendix F: DFS Detection Thresholds

### Test Result

| TestMode   | Frequency[MHz] | Radar Type | Result[dbm] | Limit[dbm] | Verdict |
|------------|----------------|------------|-------------|------------|---------|
| 11AX80SISO | 5290           | Type0      | -62.42      | -62.00     | PASS    |
|            | 5530           | Type0      | -62.06      | -62.00     | PASS    |

## Test Graphs

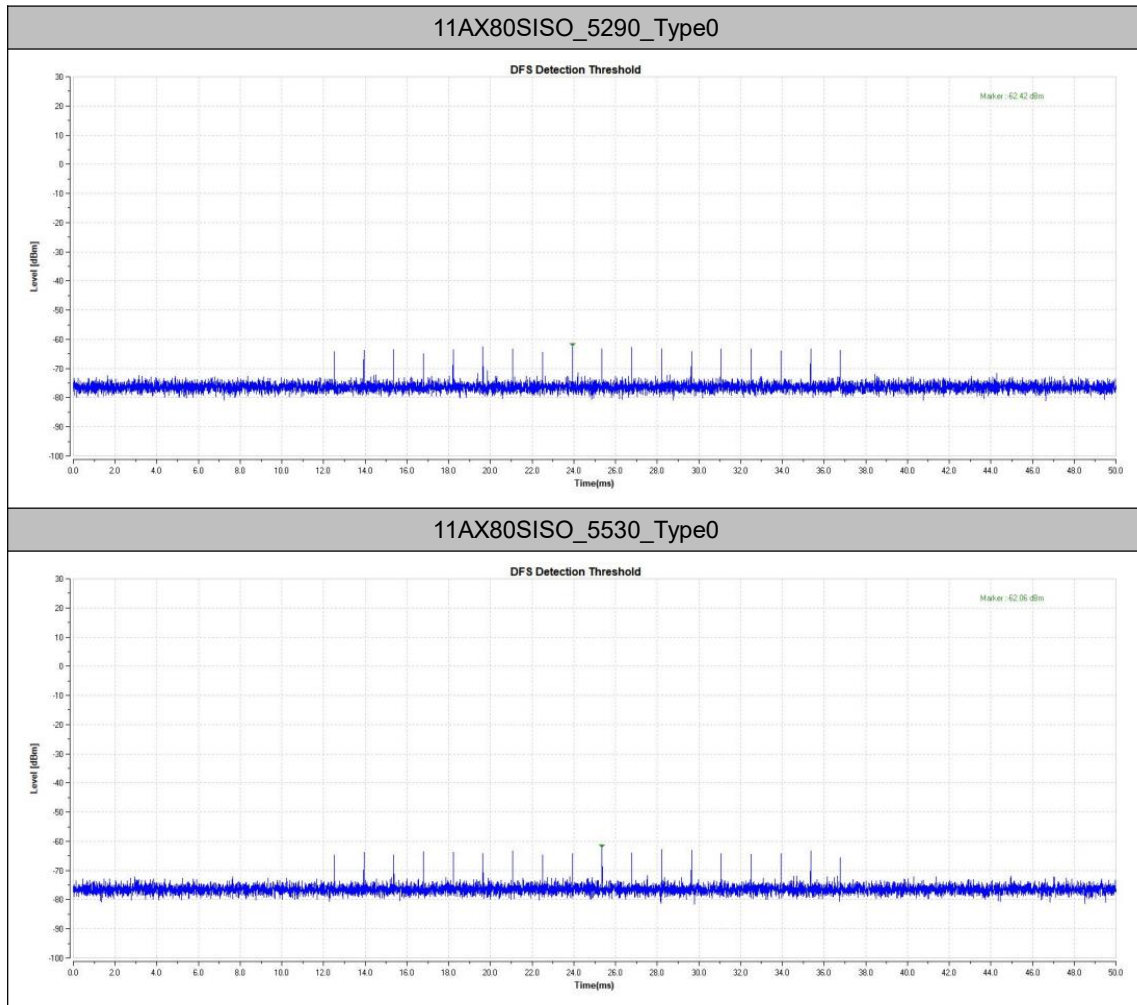

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

---


## Appendix G: Channel Move Time and Channel Closing

### Transmission Time

#### Test Result

| TestMode   | Frequency[MHz] | CCT[ms]  | Limit[ms] | CMT[ms] | Limit[ms] | Verdict |
|------------|----------------|----------|-----------|---------|-----------|---------|
| 11AX80SISO | 5290           | 200+13.0 | 200+60    | 494.0   | 10000     | PASS    |
| 11AX80SISO | 5530           | 200+16.9 | 200+60    | 486.2   | 10000     | PASS    |

## Test Graphs

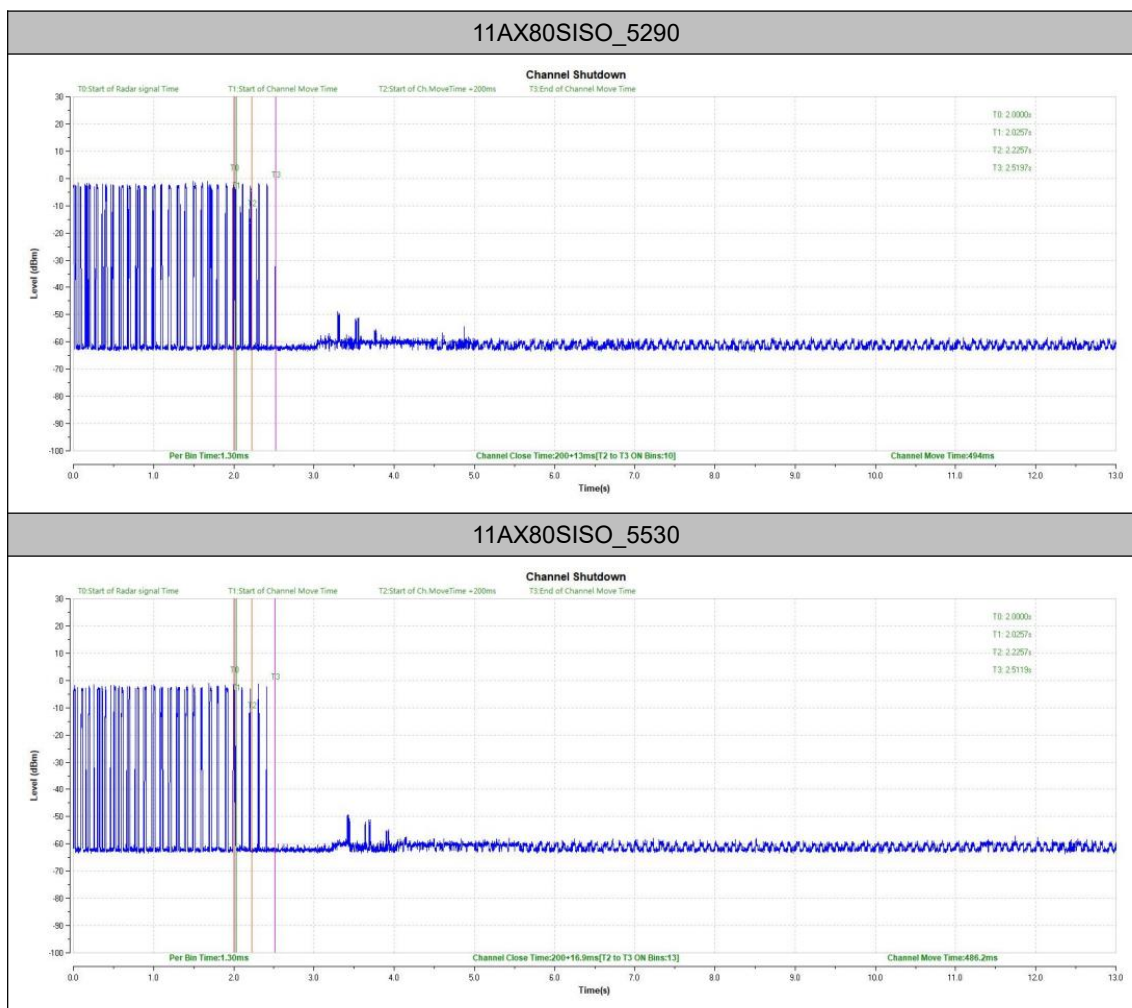

---End---