

Appendix Test Data

Report No.:	1813C50438012503-01	Test Sample No.:	1-2-2
Start Test Date:	2025-10-22	Finish Test Date:	2025-10-25
Test Engineer:	Alex Peng	Auditor:	Justin Feng
Temperature:	22.8°C	Relative Humidity:	48%
Pressure:	101kPa		



Appendix A1: 26dB Bandwidth

Test Result

Test Mode	Antenna	Frequency[MHz]	26db EBW [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5180	17.440	5171.320	5188.760	---	---
11A	Ant1	5220	17.440	5211.320	5228.760	---	---
11A	Ant1	5240	17.400	5231.320	5248.720	---	---
11A	Ant1	5260	17.400	5251.320	5268.720	---	---
11A	Ant1	5300	17.440	5291.320	5308.760	---	---
11A	Ant1	5320	17.400	5311.320	5328.720	---	---
11A	Ant1	5500	17.400	5491.320	5508.720	---	---
11A	Ant1	5580	17.400	5571.320	5588.720	---	---
11A	Ant1	5700	17.400	5691.320	5708.720	---	---
11A	Ant1	5745	17.400	5736.320	5753.720	---	---
11A	Ant1	5785	17.400	5776.320	5793.720	---	---
11A	Ant1	5825	17.400	5816.320	5833.720	---	---
11N20SISO	Ant1	5180	18.680	5170.680	5189.360	---	---
11N20SISO	Ant1	5220	18.680	5210.680	5229.360	---	---
11N20SISO	Ant1	5240	18.680	5230.680	5249.360	---	---
11N20SISO	Ant1	5260	18.680	5250.680	5269.360	---	---
11N20SISO	Ant1	5300	18.680	5290.680	5309.360	---	---
11N20SISO	Ant1	5320	18.680	5310.680	5329.360	---	---
11N20SISO	Ant1	5500	18.680	5490.680	5509.360	---	---
11N20SISO	Ant1	5580	18.680	5570.680	5589.360	---	---
11N20SISO	Ant1	5700	18.680	5690.680	5709.360	---	---
11N20SISO	Ant1	5745	18.680	5735.680	5754.360	---	---
11N20SISO	Ant1	5785	18.680	5775.680	5794.360	---	---
11N20SISO	Ant1	5825	18.680	5815.680	5834.360	---	---
11N40SISO	Ant1	5190	38.240	5170.960	5209.200	---	---

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

11N40SISO	Ant1	5230	38.240	5210.960	5249.200	---	---
11N40SISO	Ant1	5270	38.240	5250.960	5289.200	---	---
11N40SISO	Ant1	5310	38.240	5290.960	5329.200	---	---
11N40SISO	Ant1	5510	38.240	5490.960	5529.200	---	---
11N40SISO	Ant1	5550	38.240	5530.960	5569.200	---	---
11N40SISO	Ant1	5670	38.240	5650.960	5689.200	---	---
11N40SISO	Ant1	5755	38.320	5735.880	5774.200	---	---
11N40SISO	Ant1	5795	38.320	5775.880	5814.200	---	---
11AC20SISO	Ant1	5180	18.680	5170.680	5189.360	---	---
11AC20SISO	Ant1	5220	18.640	5210.720	5229.360	---	---
11AC20SISO	Ant1	5240	18.680	5230.680	5249.360	---	---
11AC20SISO	Ant1	5260	18.680	5250.680	5269.360	---	---
11AC20SISO	Ant1	5300	18.680	5290.680	5309.360	---	---
11AC20SISO	Ant1	5320	18.680	5310.680	5329.360	---	---
11AC20SISO	Ant1	5500	18.680	5490.680	5509.360	---	---
11AC20SISO	Ant1	5580	18.680	5570.680	5589.360	---	---
11AC20SISO	Ant1	5700	18.680	5690.680	5709.360	---	---
11AC20SISO	Ant1	5745	18.680	5735.680	5754.360	---	---
11AC20SISO	Ant1	5785	18.680	5775.680	5794.360	---	---
11AC20SISO	Ant1	5825	18.680	5815.680	5834.360	---	---
11AC40SISO	Ant1	5190	38.240	5170.960	5209.200	---	---
11AC40SISO	Ant1	5230	38.240	5210.960	5249.200	---	---
11AC40SISO	Ant1	5270	38.240	5250.960	5289.200	---	---
11AC40SISO	Ant1	5310	38.240	5290.960	5329.200	---	---
11AC40SISO	Ant1	5510	38.240	5490.960	5529.200	---	---
11AC40SISO	Ant1	5550	38.240	5530.960	5569.200	---	---
11AC40SISO	Ant1	5670	38.240	5650.960	5689.200	---	---
11AC40SISO	Ant1	5755	38.320	5735.880	5774.200	---	---
11AC40SISO	Ant1	5795	38.320	5775.880	5814.200	---	---
11AC80SISO	Ant1	5210	91.680	5165.200	5256.880	---	---
11AC80SISO	Ant1	5290	88.800	5246.160	5334.960	---	---
11AC80SISO	Ant1	5530	89.280	5485.840	5575.120	---	---
11AC80SISO	Ant1	5775	89.920	5730.200	5820.120	---	---
11AX20SISO	Ant1	5180	20.080	5170.000	5190.080	---	---
11AX20SISO	Ant1	5220	20.080	5210.000	5230.080	---	---
11AX20SISO	Ant1	5240	20.080	5230.000	5250.080	---	---
11AX20SISO	Ant1	5260	20.080	5250.000	5270.080	---	---
11AX20SISO	Ant1	5300	20.080	5290.000	5310.080	---	---
11AX20SISO	Ant1	5320	20.080	5310.000	5330.080	---	---
11AX20SISO	Ant1	5500	20.080	5490.000	5510.080	---	---
11AX20SISO	Ant1	5580	20.080	5570.000	5590.080	---	---
11AX20SISO	Ant1	5700	20.080	5690.000	5710.080	---	---

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


11AX20SISO	Ant1	5745	20.080	5735.000	5755.080	---	---
11AX20SISO	Ant1	5785	20.080	5775.000	5795.080	---	---
11AX20SISO	Ant1	5825	20.080	5815.000	5835.080	---	---
11AX40SISO	Ant1	5190	40.000	5170.080	5210.080	---	---
11AX40SISO	Ant1	5230	40.000	5210.080	5250.080	---	---
11AX40SISO	Ant1	5270	40.000	5250.080	5290.080	---	---
11AX40SISO	Ant1	5310	40.000	5290.080	5330.080	---	---
11AX40SISO	Ant1	5510	40.000	5490.080	5530.080	---	---
11AX40SISO	Ant1	5550	39.920	5530.080	5570.000	---	---
11AX40SISO	Ant1	5670	40.000	5650.080	5690.080	---	---
11AX40SISO	Ant1	5755	40.000	5735.080	5775.080	---	---
11AX40SISO	Ant1	5795	39.920	5775.080	5815.000	---	---
11AX80SISO	Ant1	5210	87.840	5167.120	5254.960	---	---
11AX80SISO	Ant1	5290	88.960	5246.160	5335.120	---	---
11AX80SISO	Ant1	5530	90.400	5485.200	5575.600	---	---
11AX80SISO	Ant1	5775	89.920	5730.040	5819.960	---	---

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Test Graphs

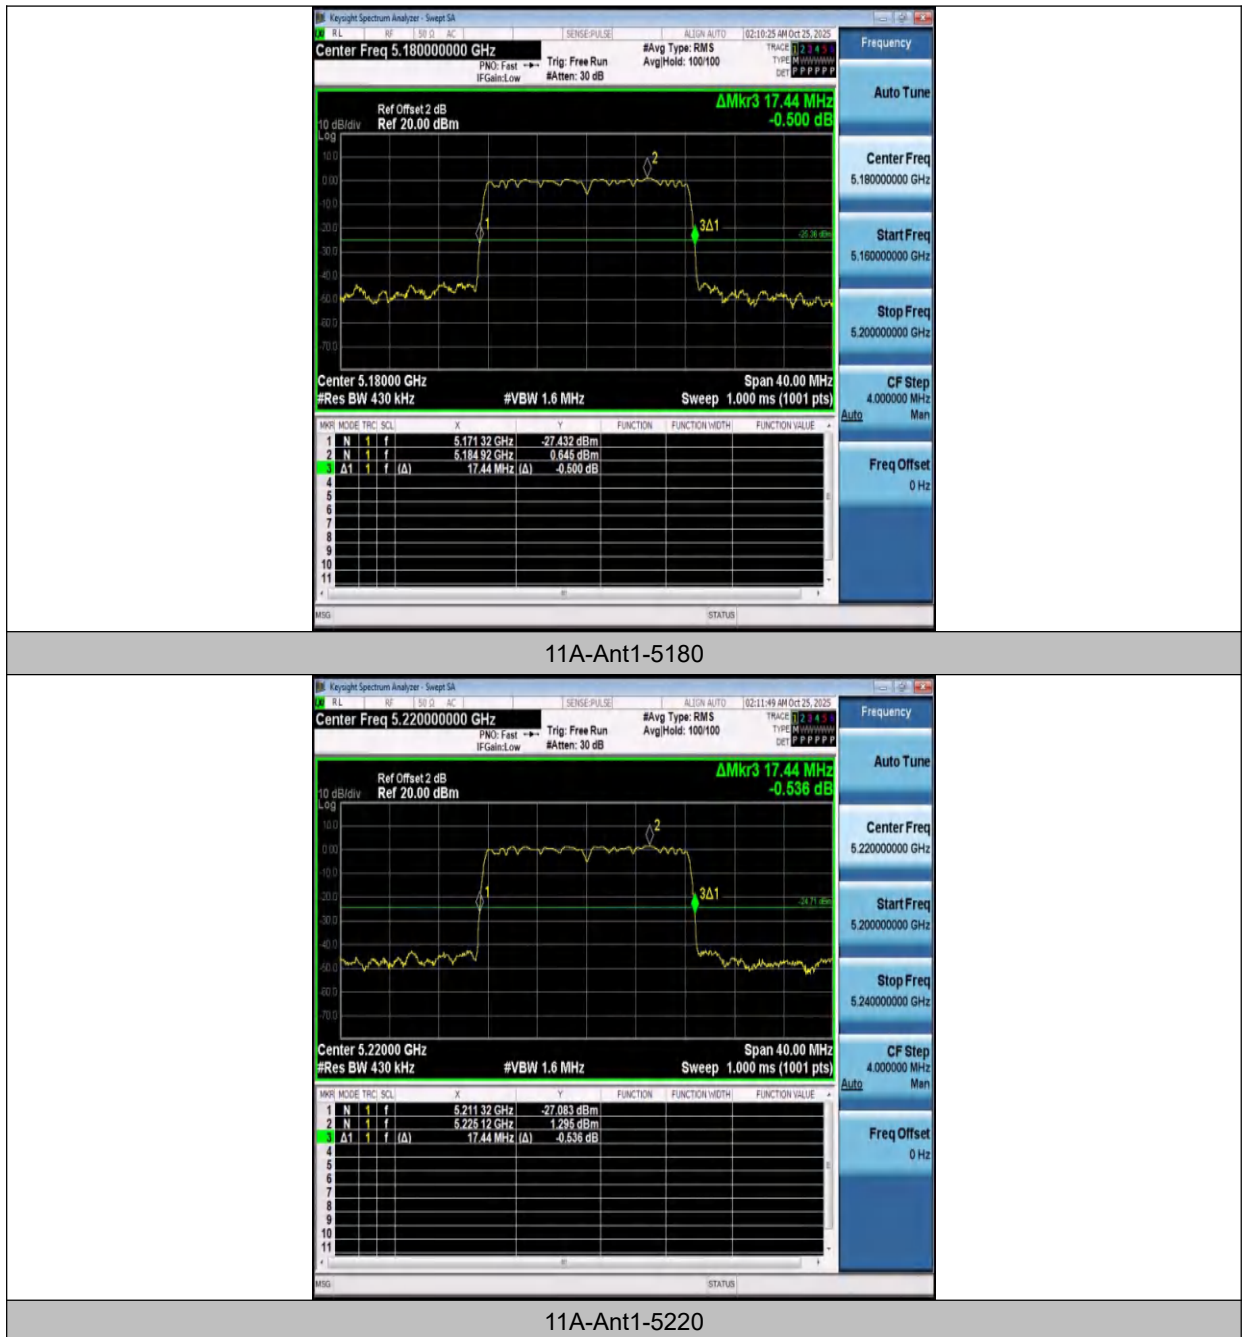

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

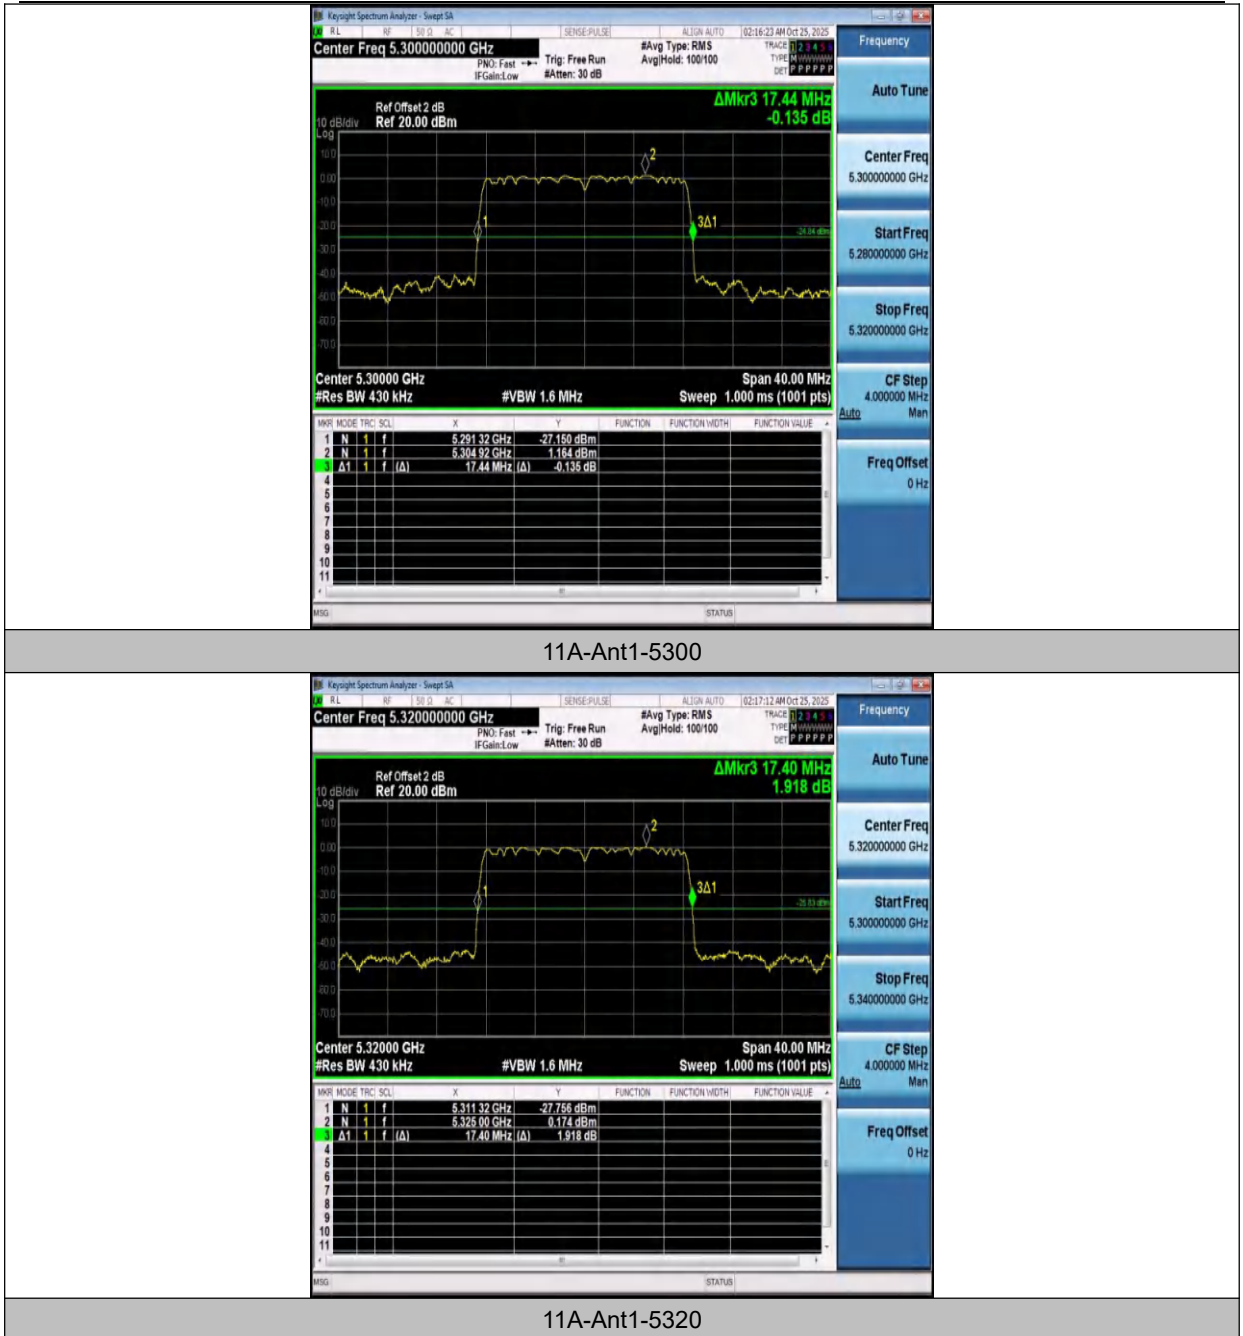

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

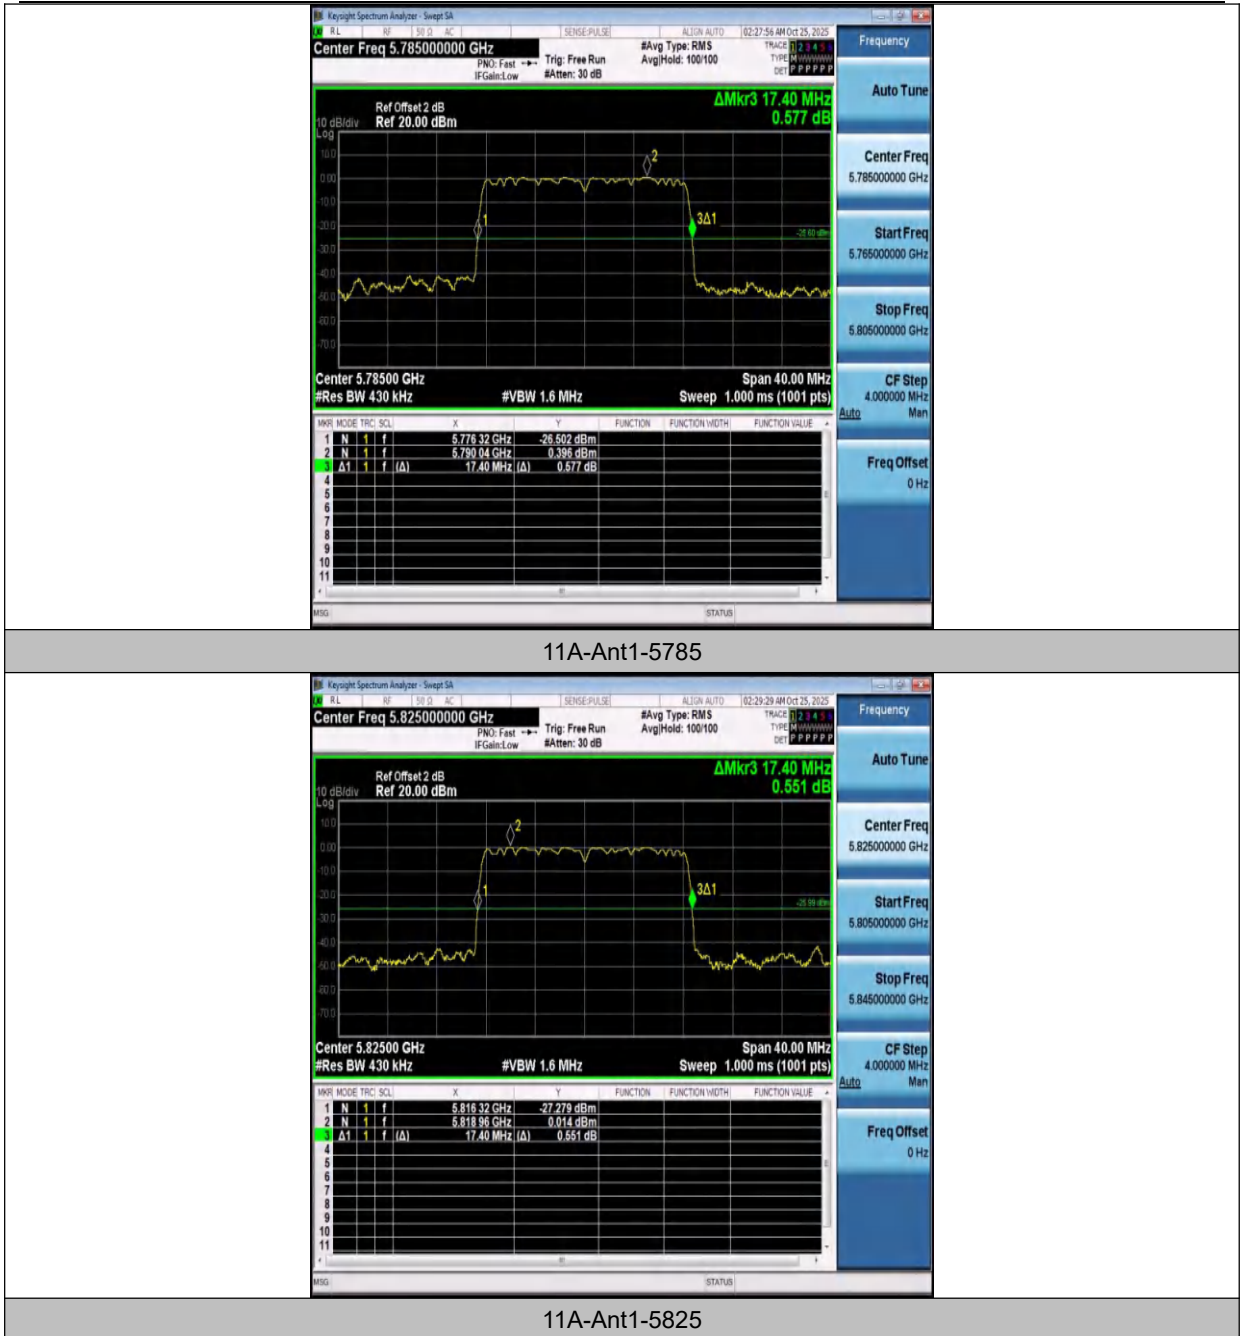

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

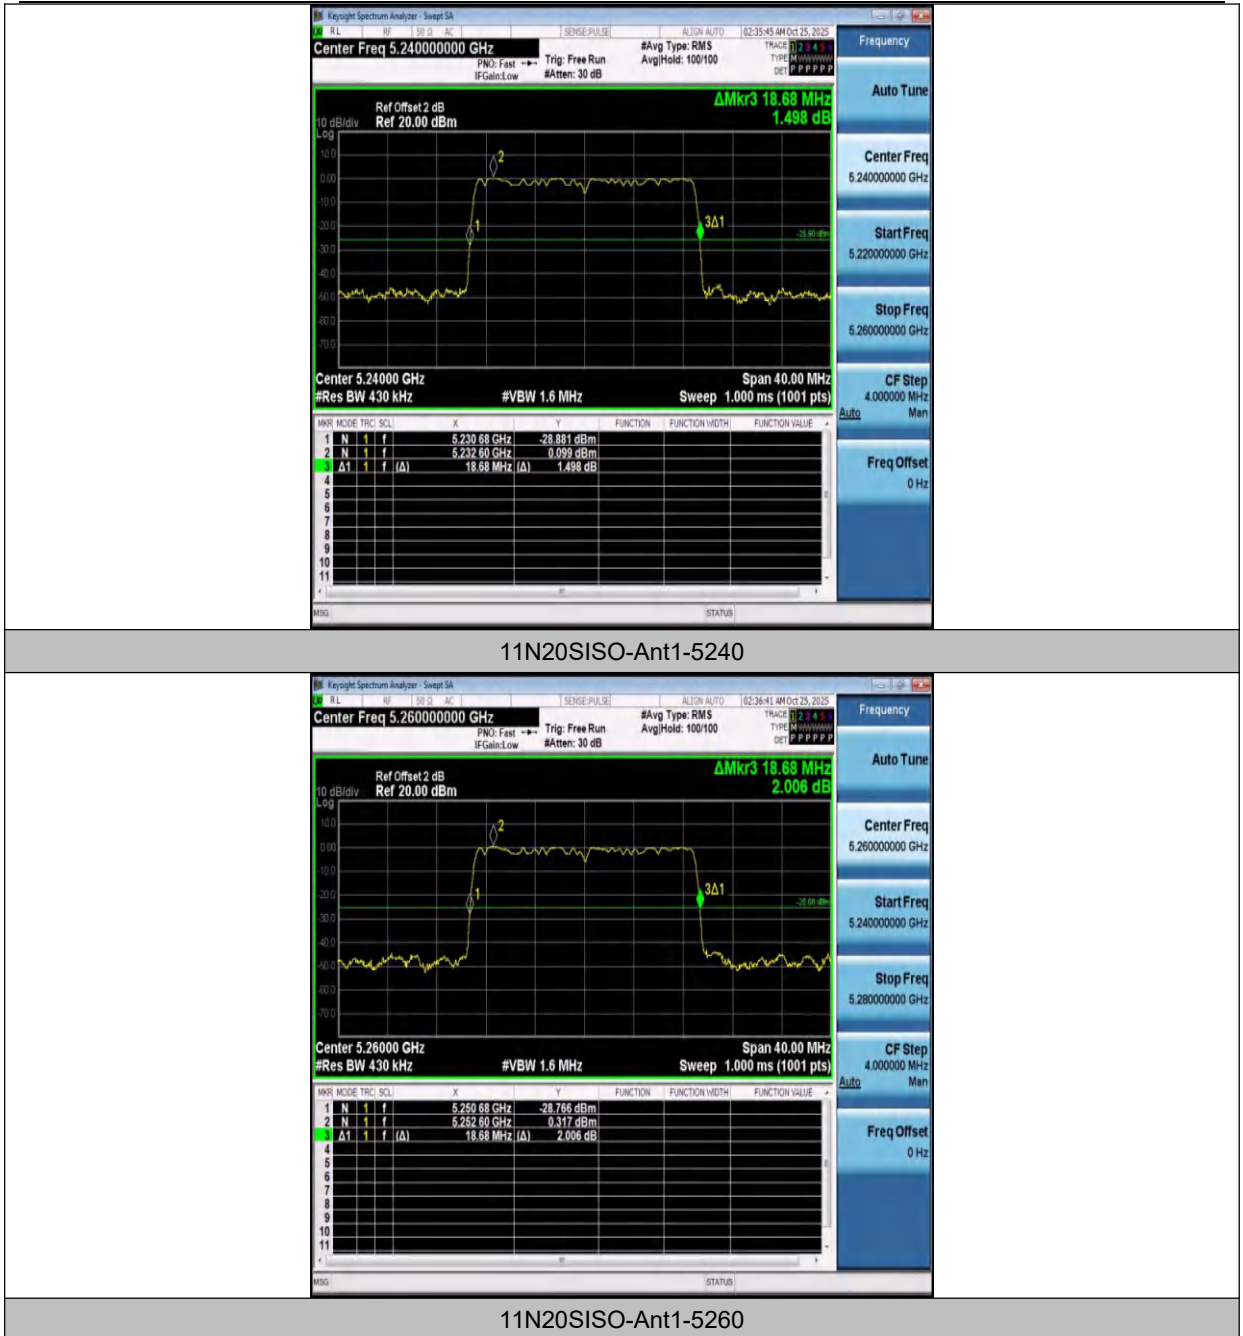




Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

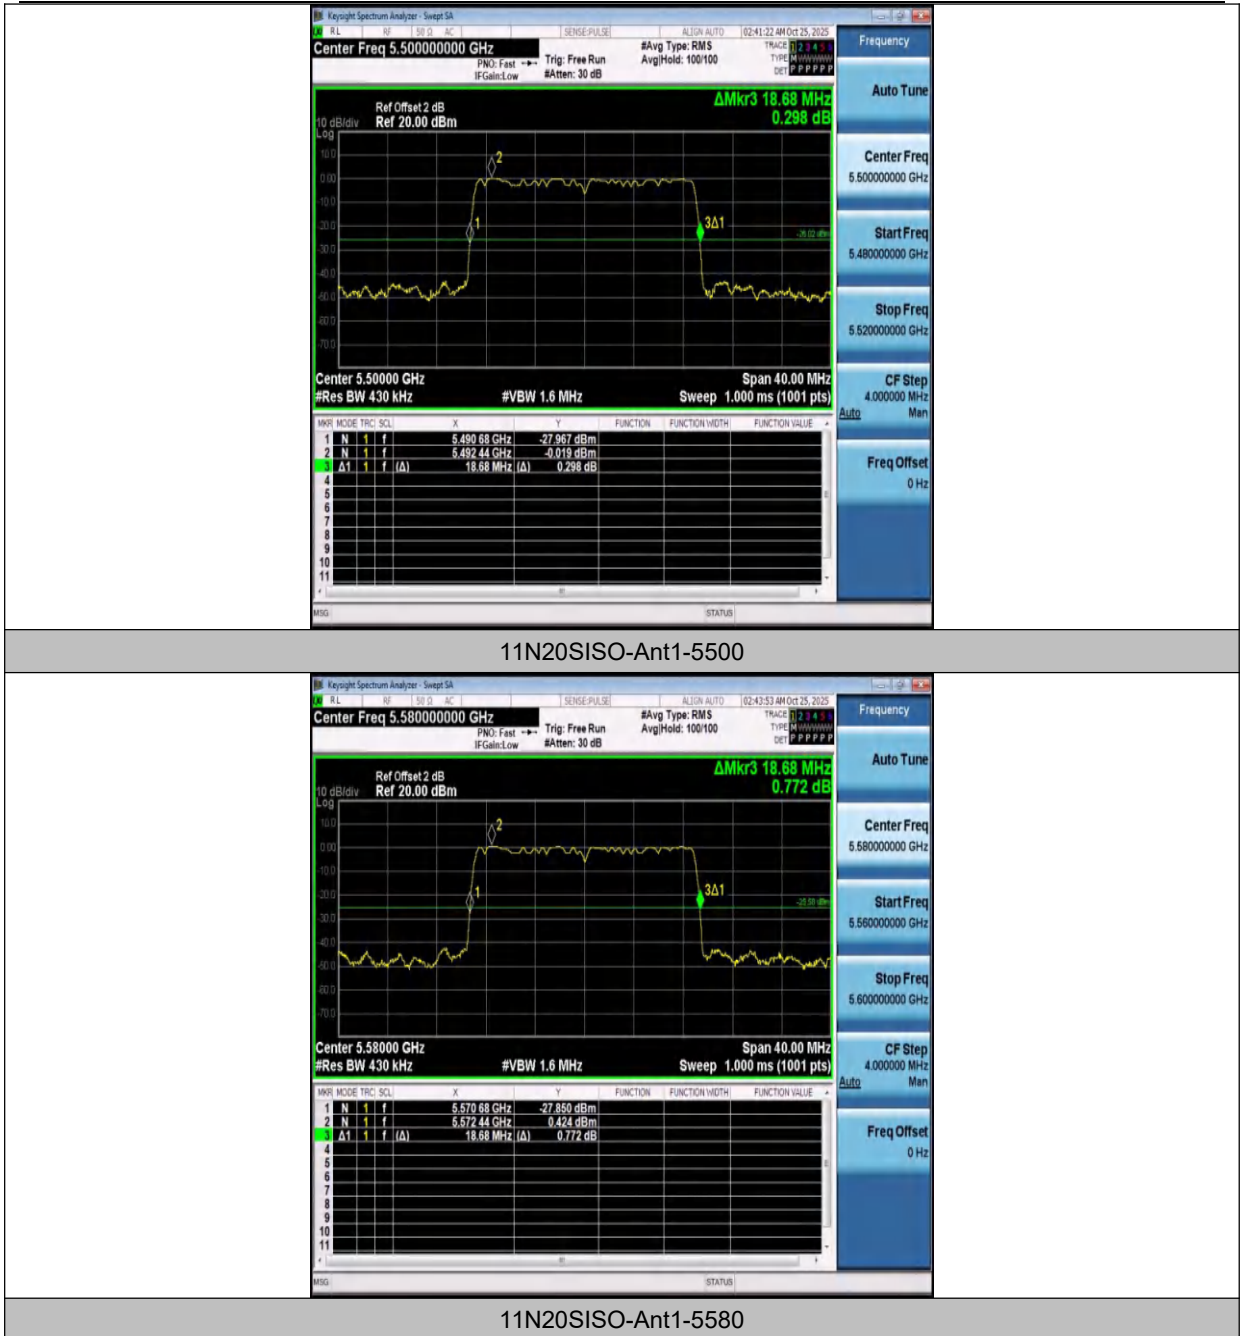







Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

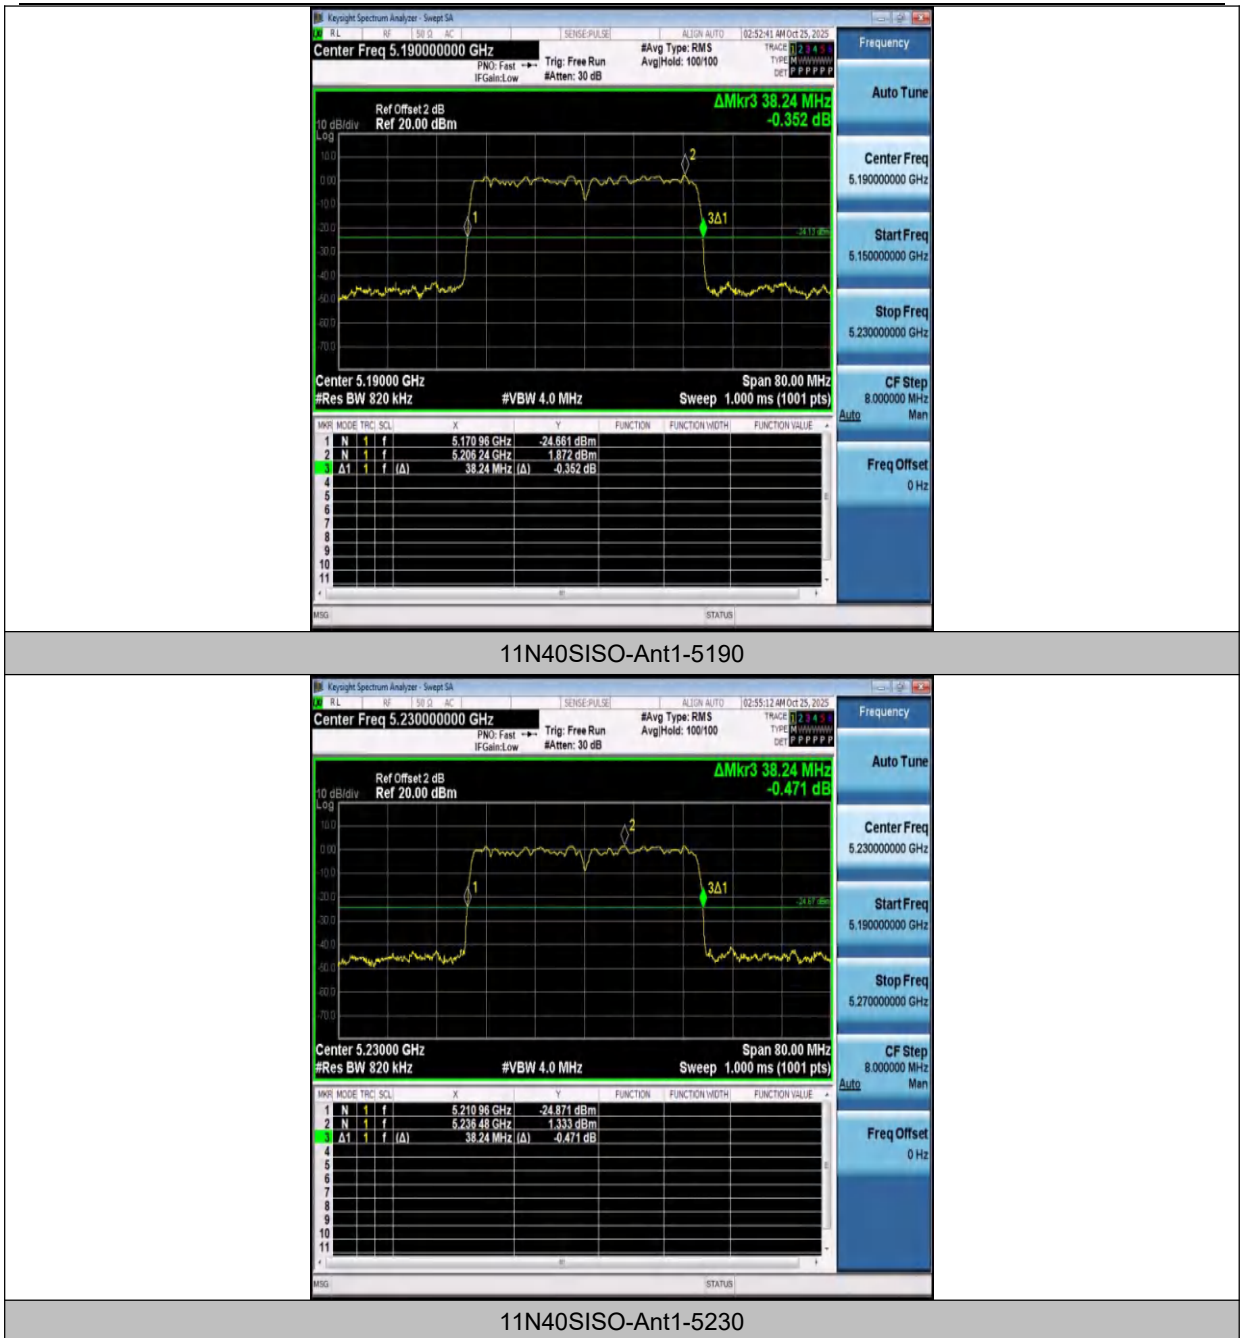

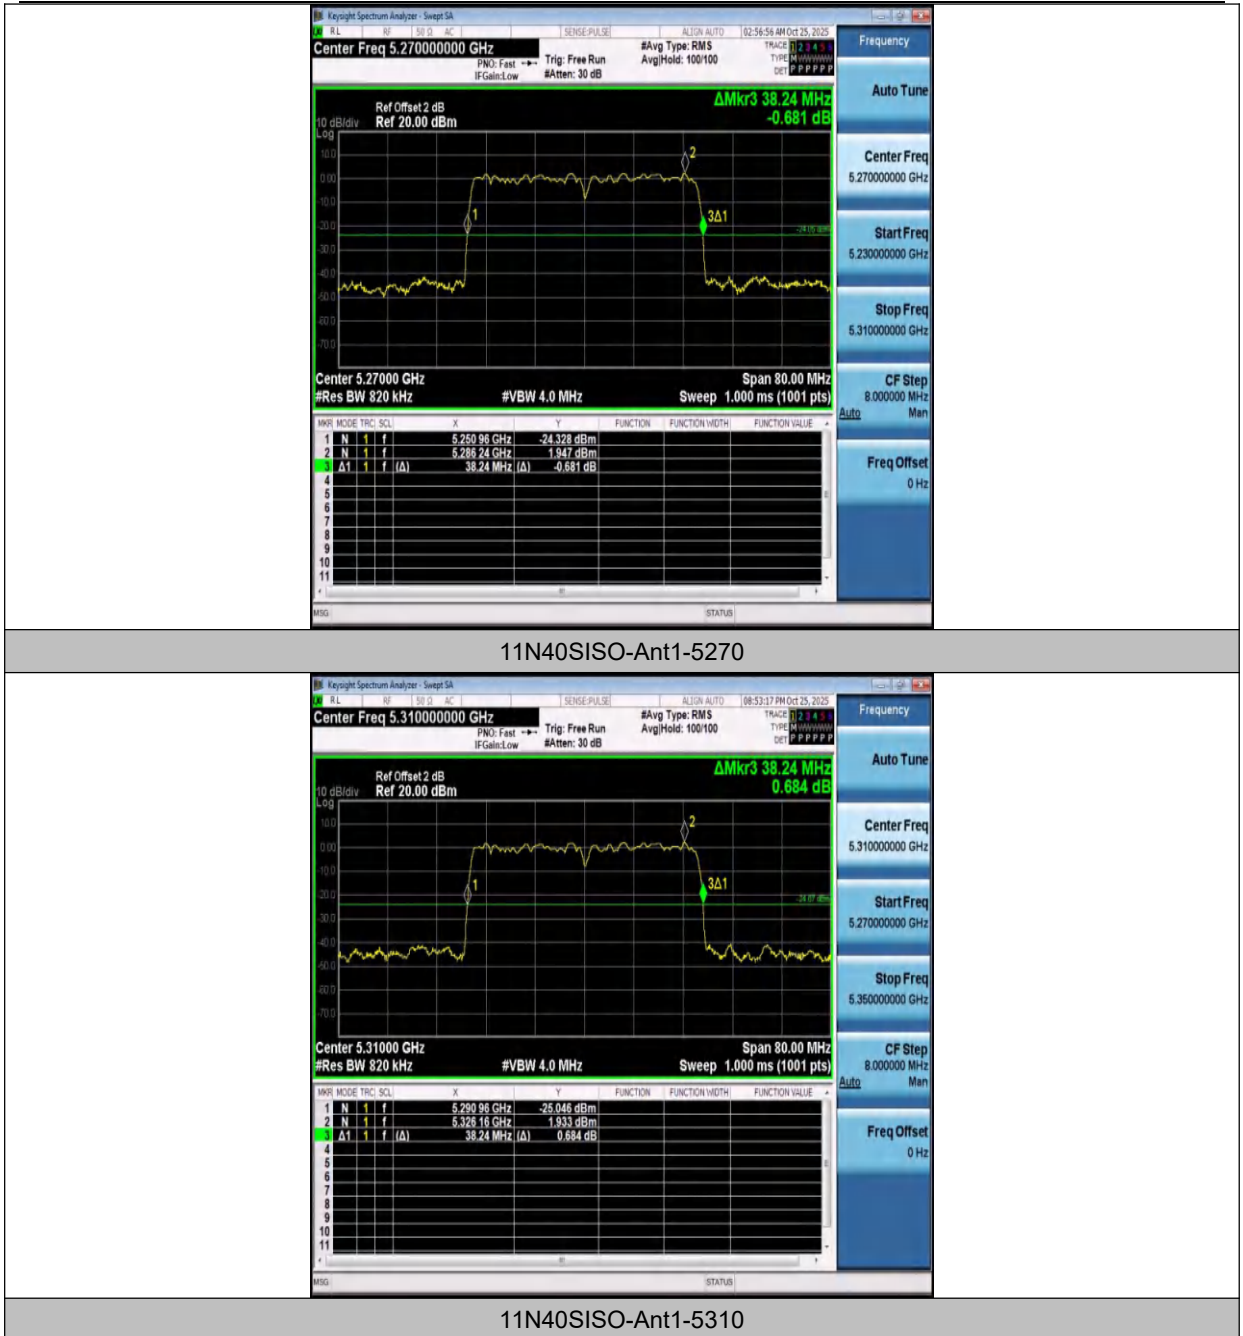




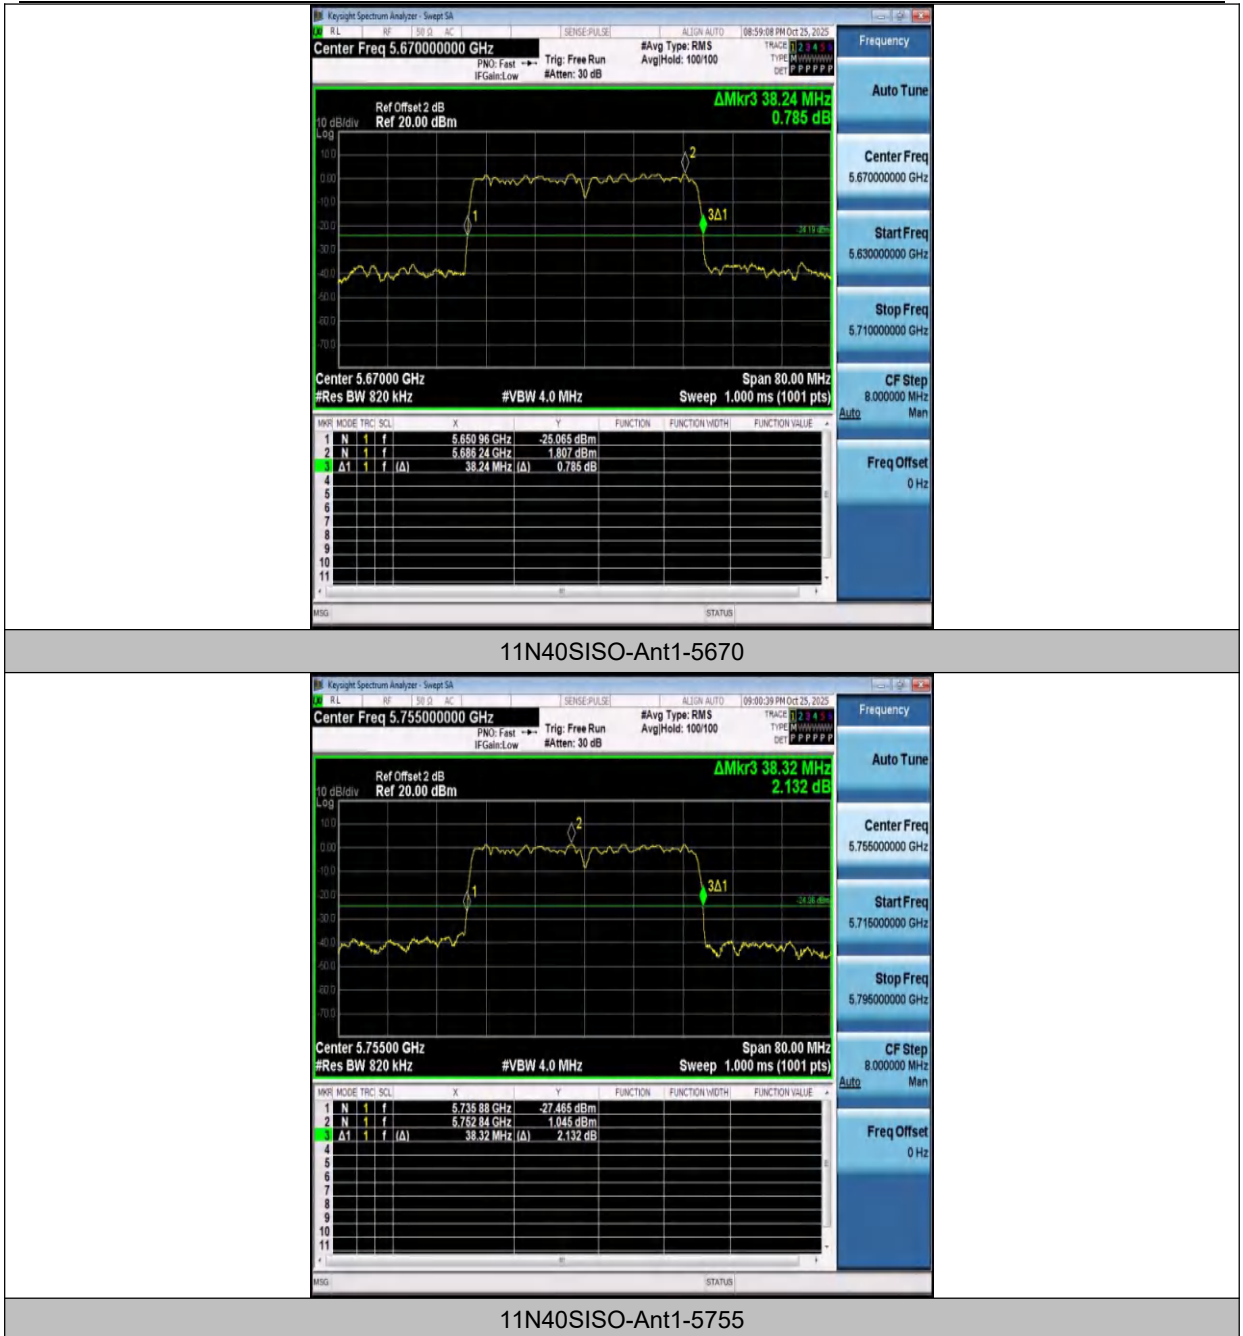


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

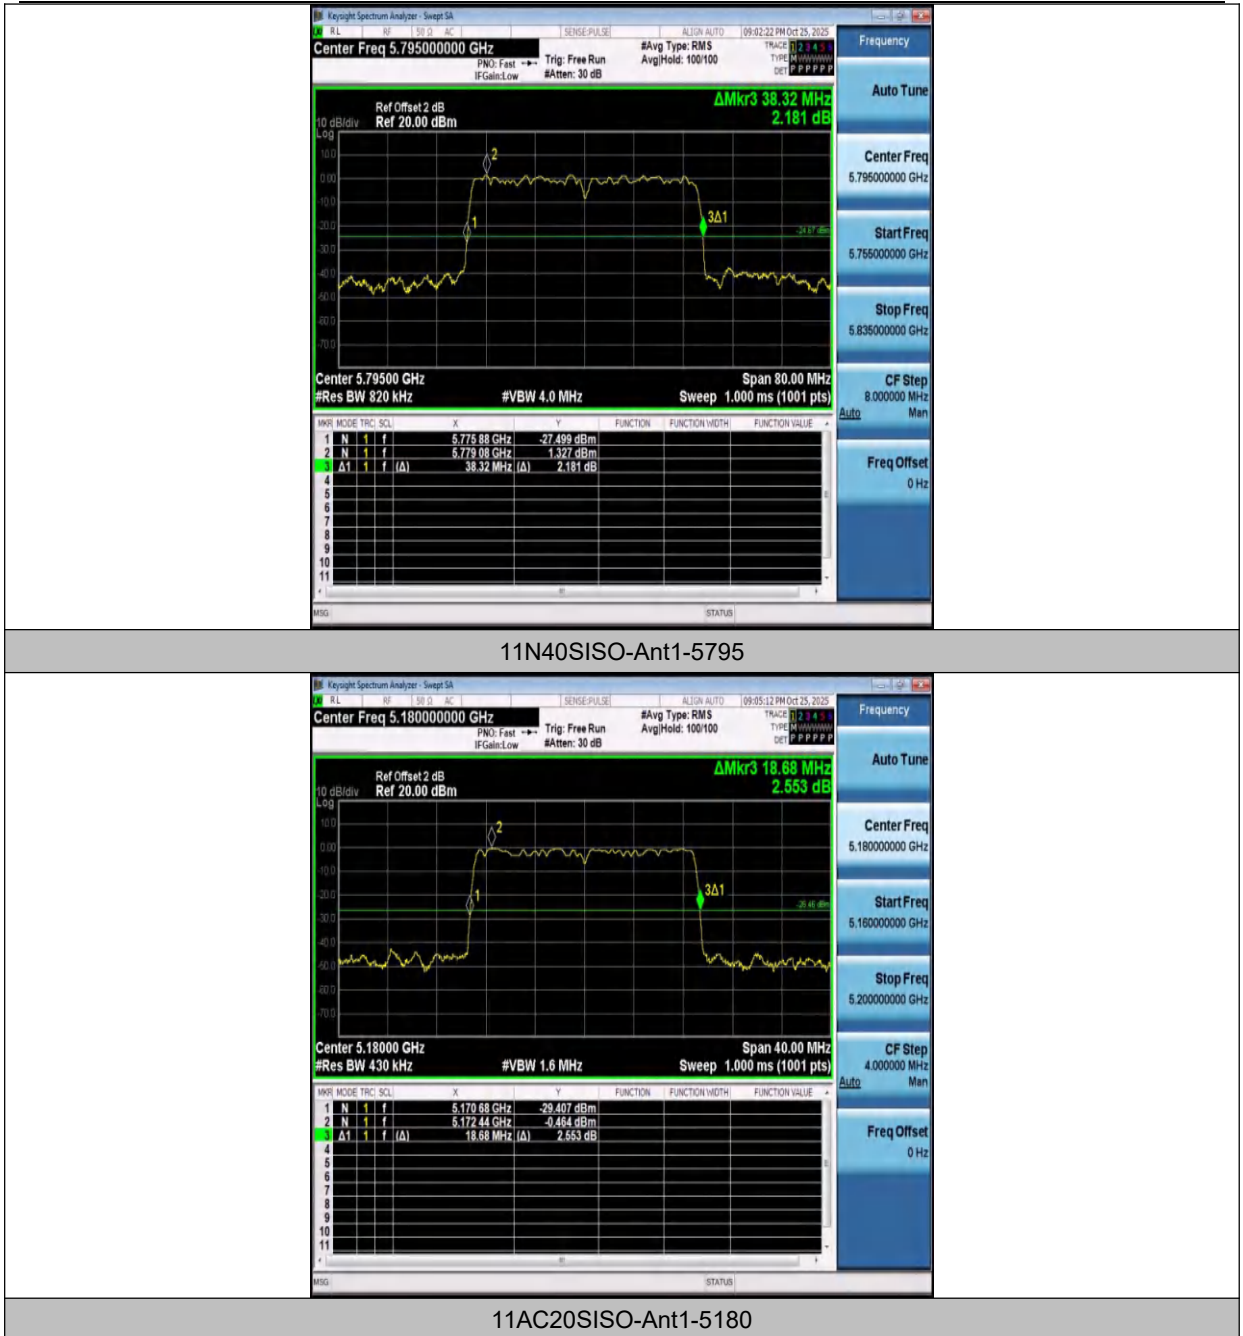


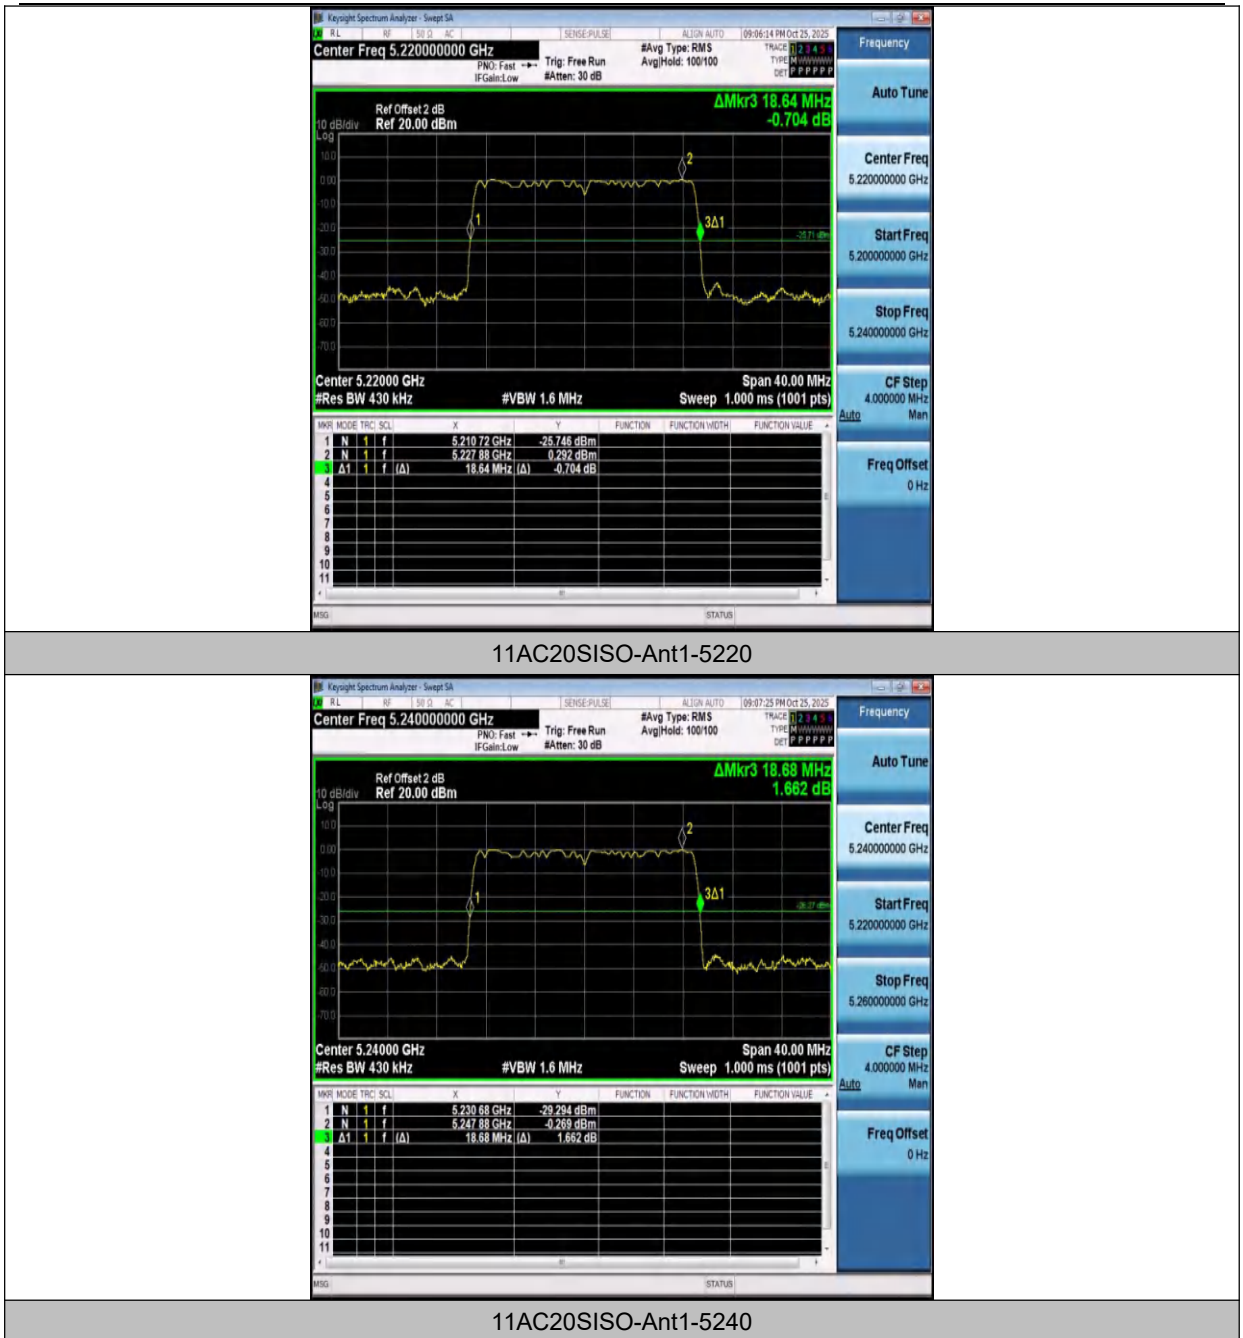



Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

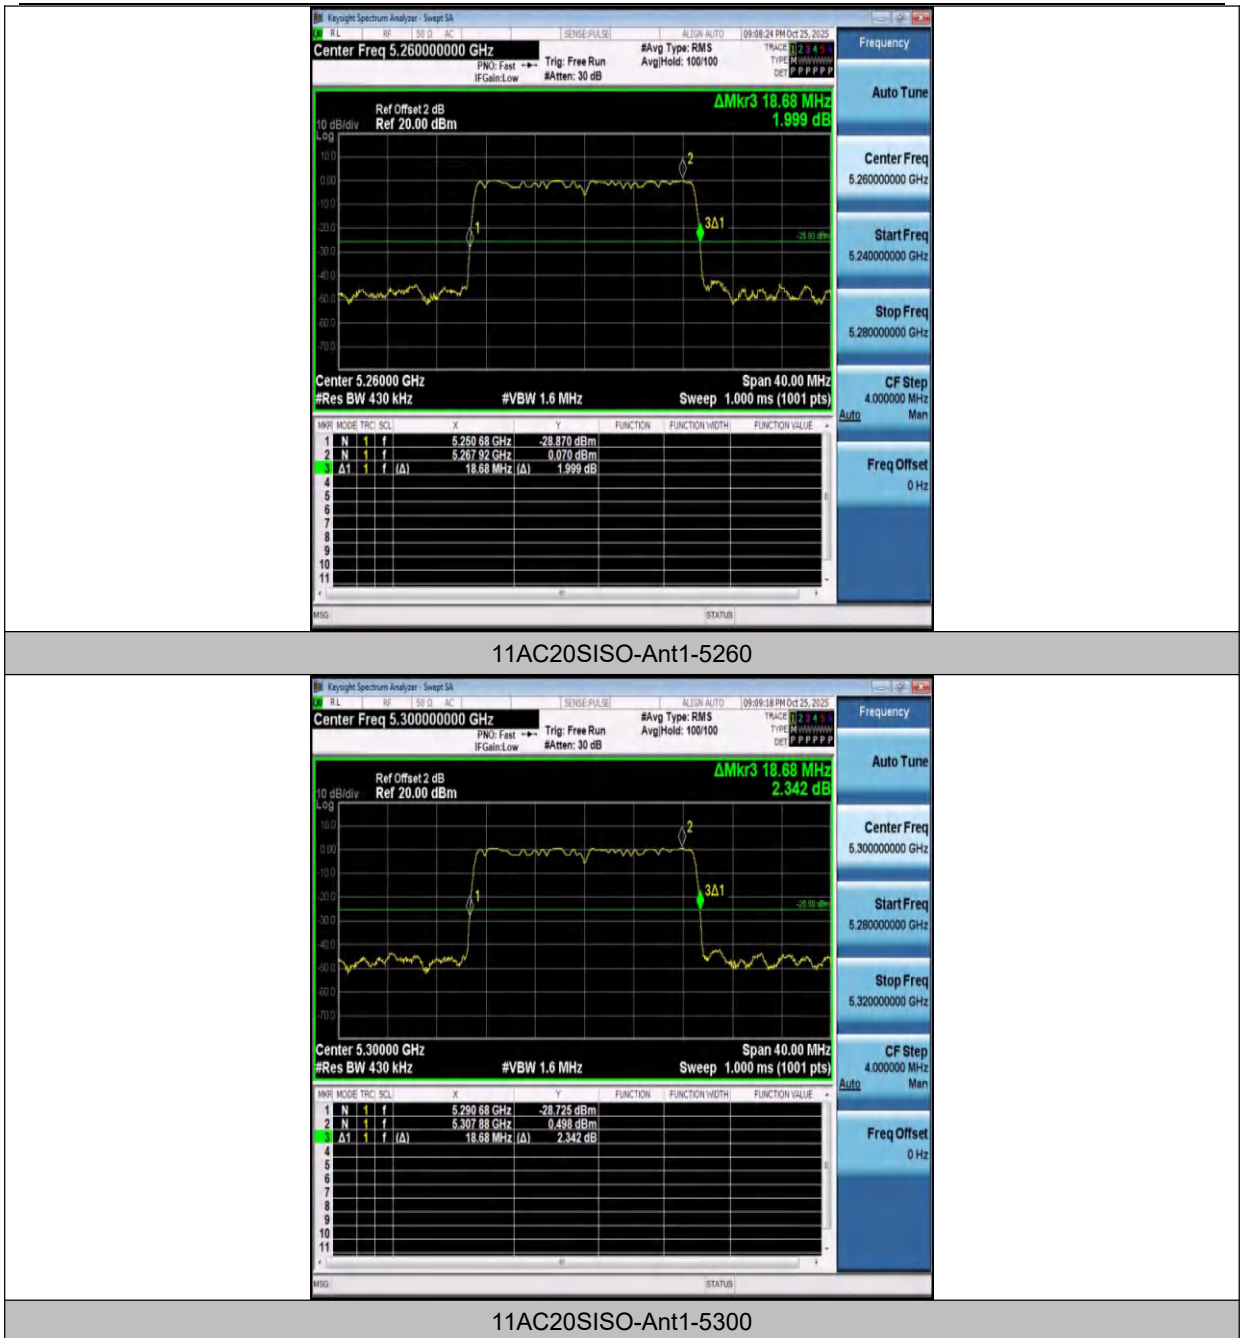

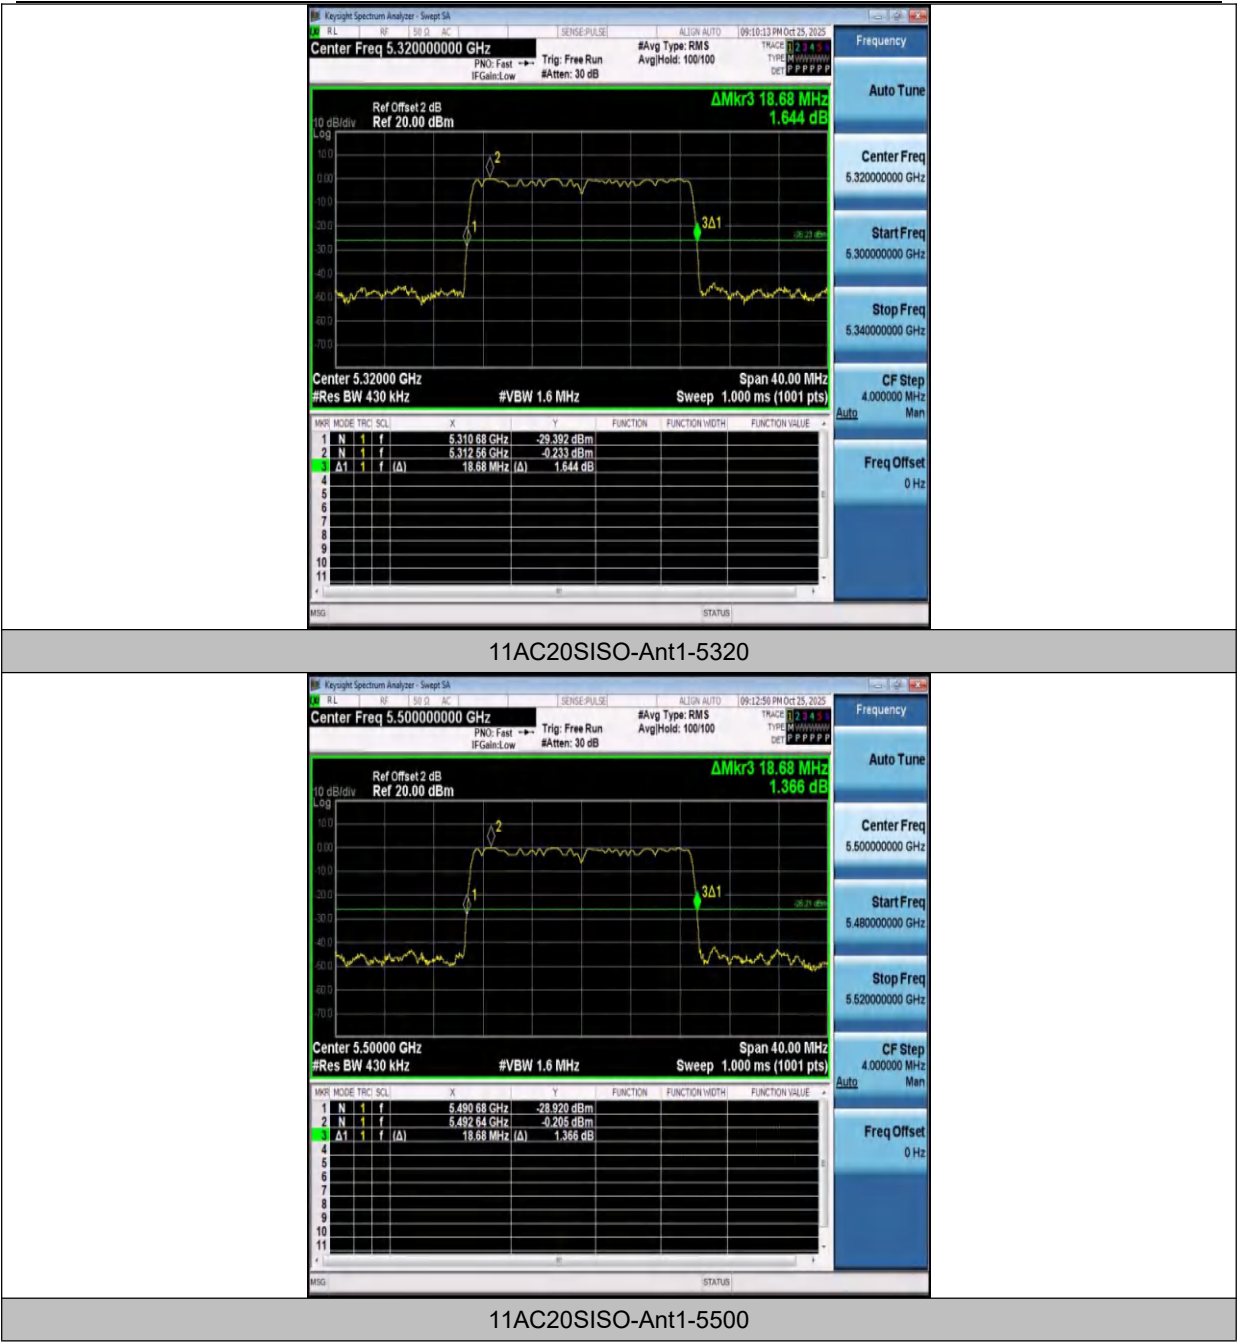

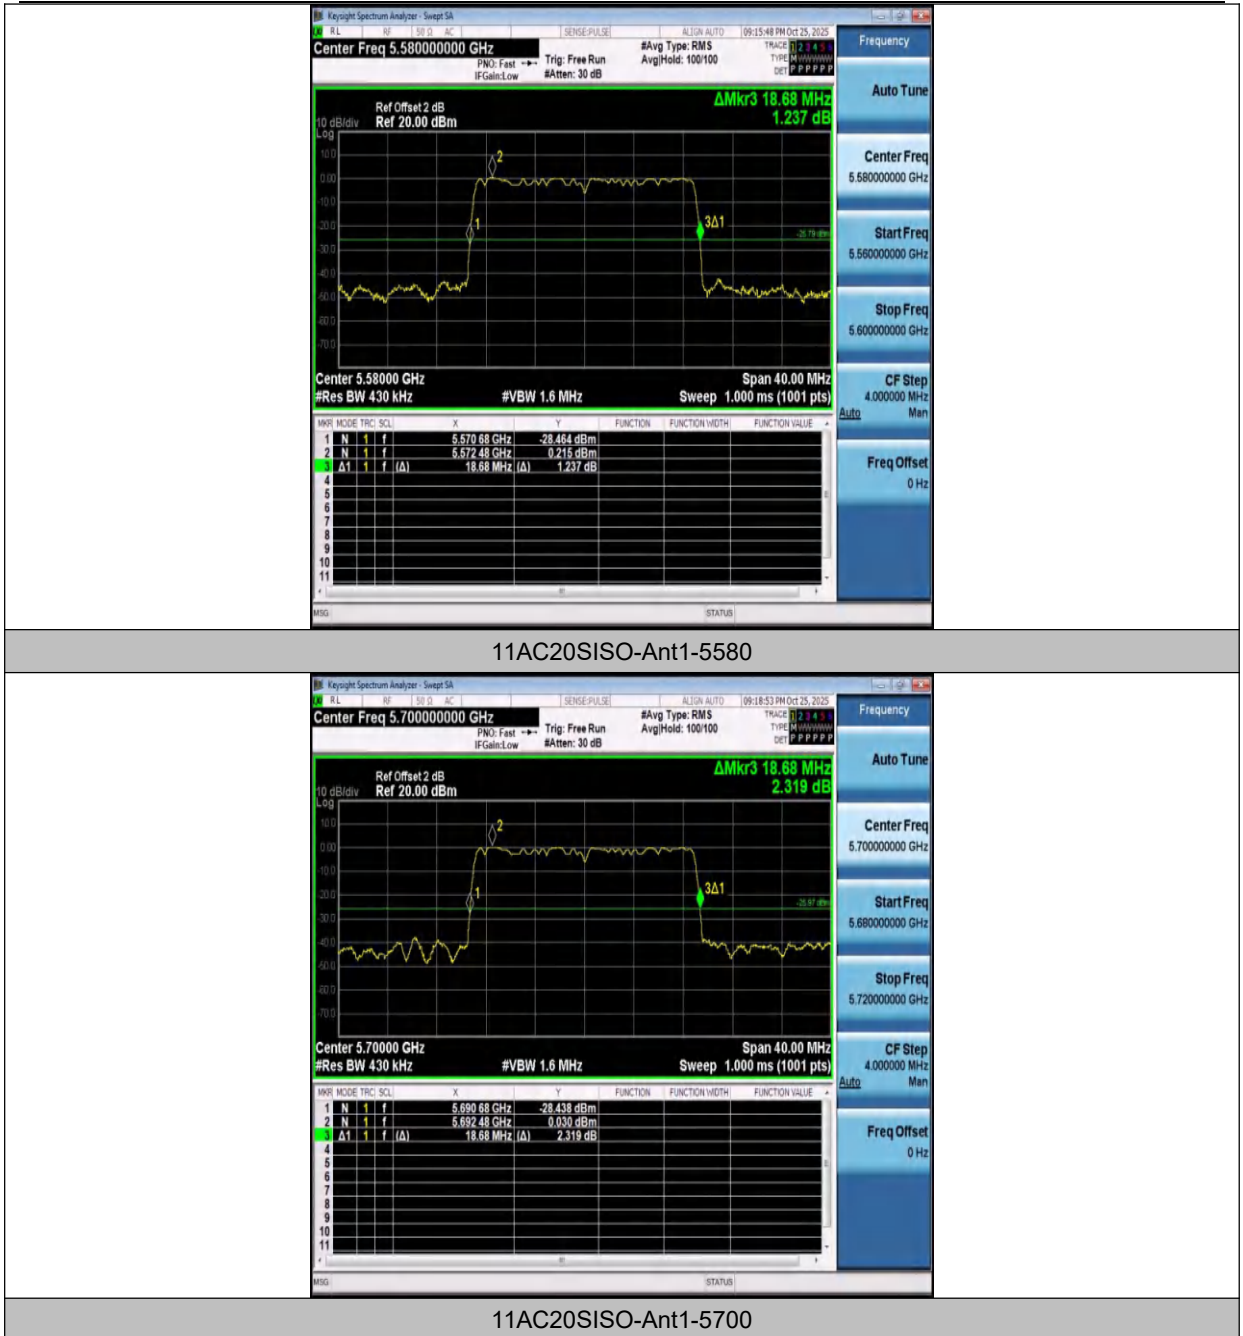


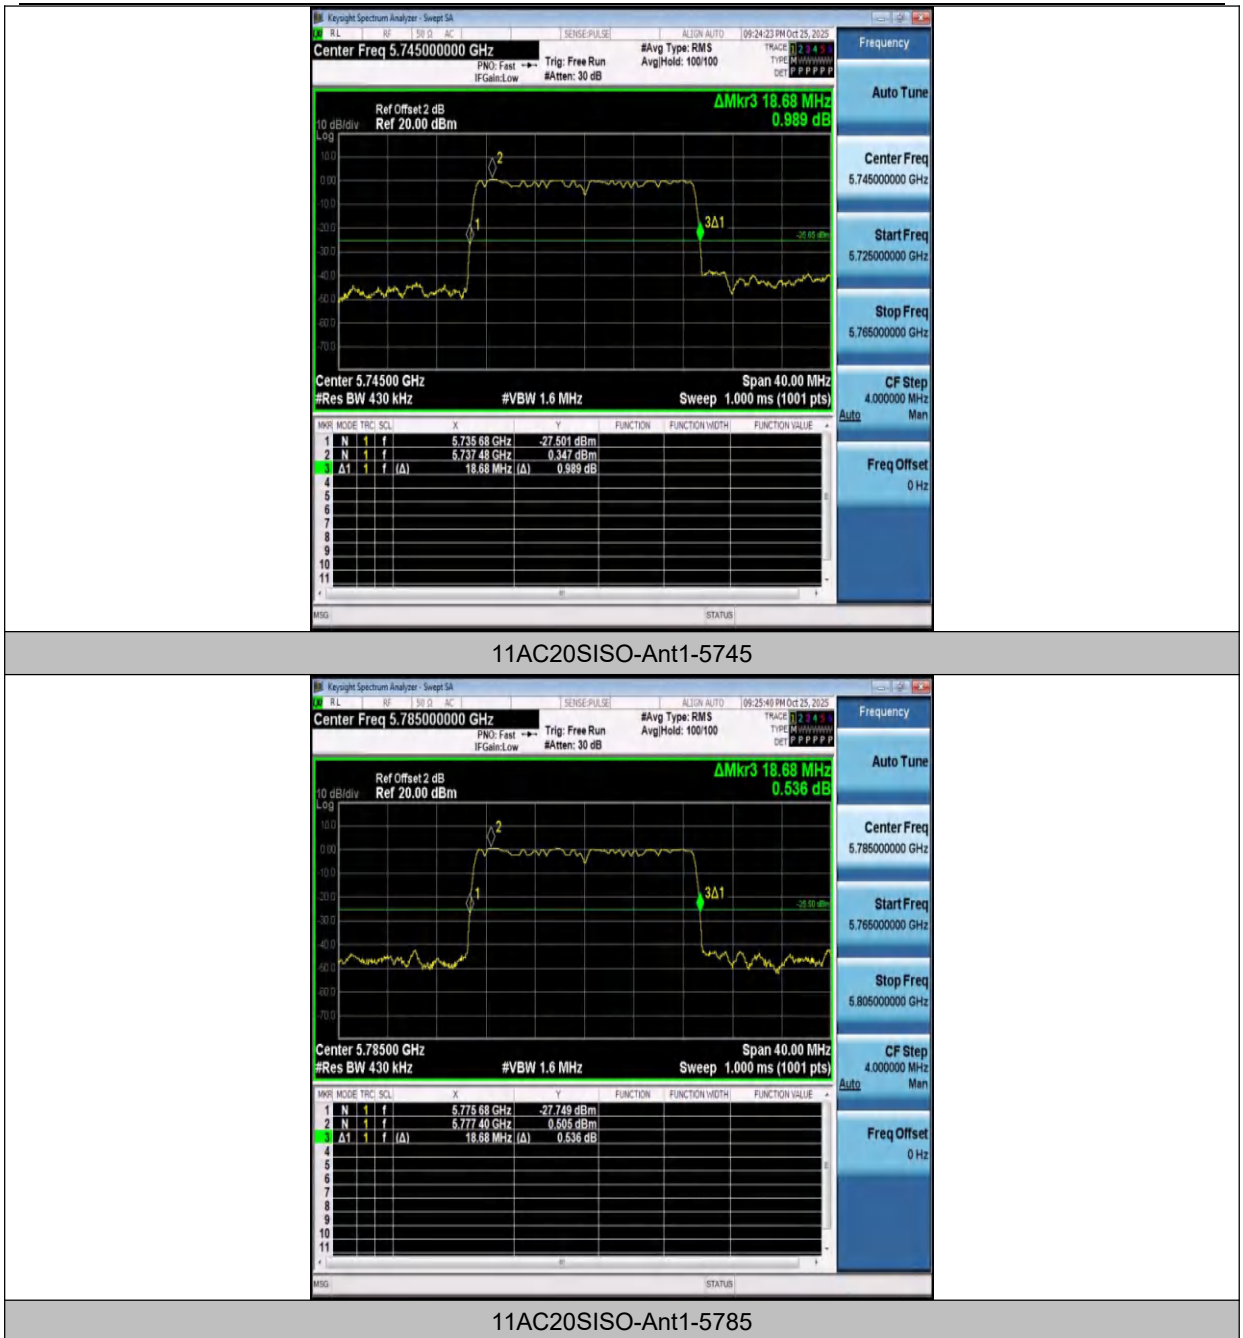



Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

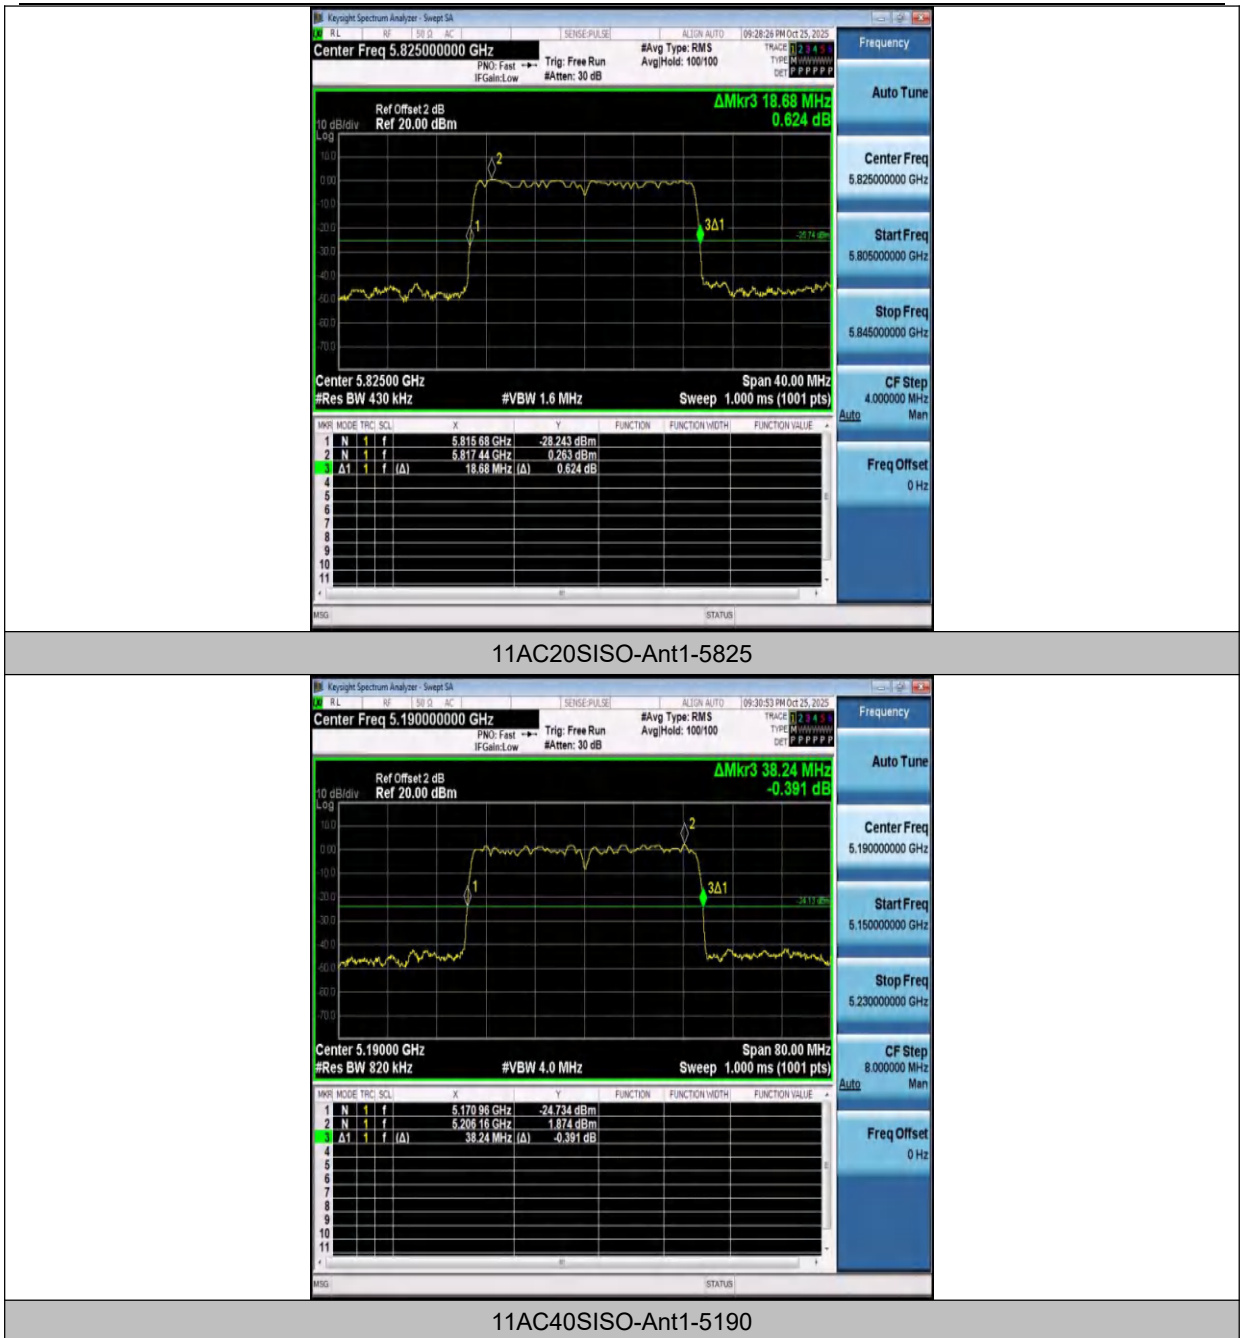

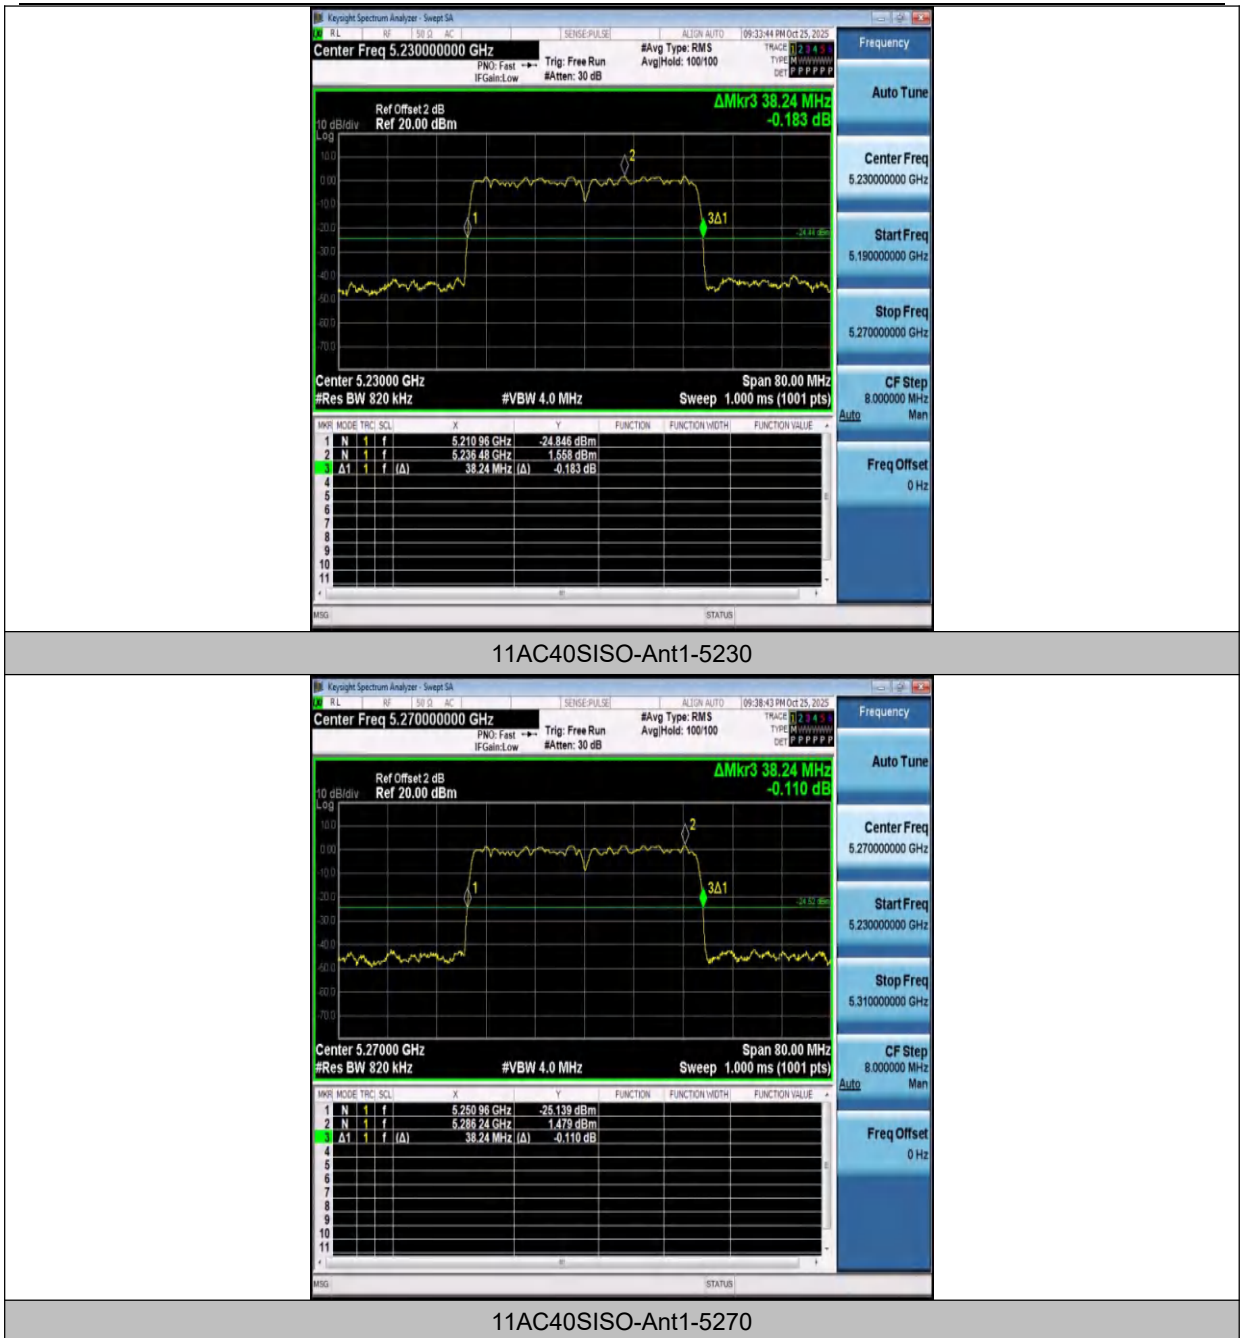

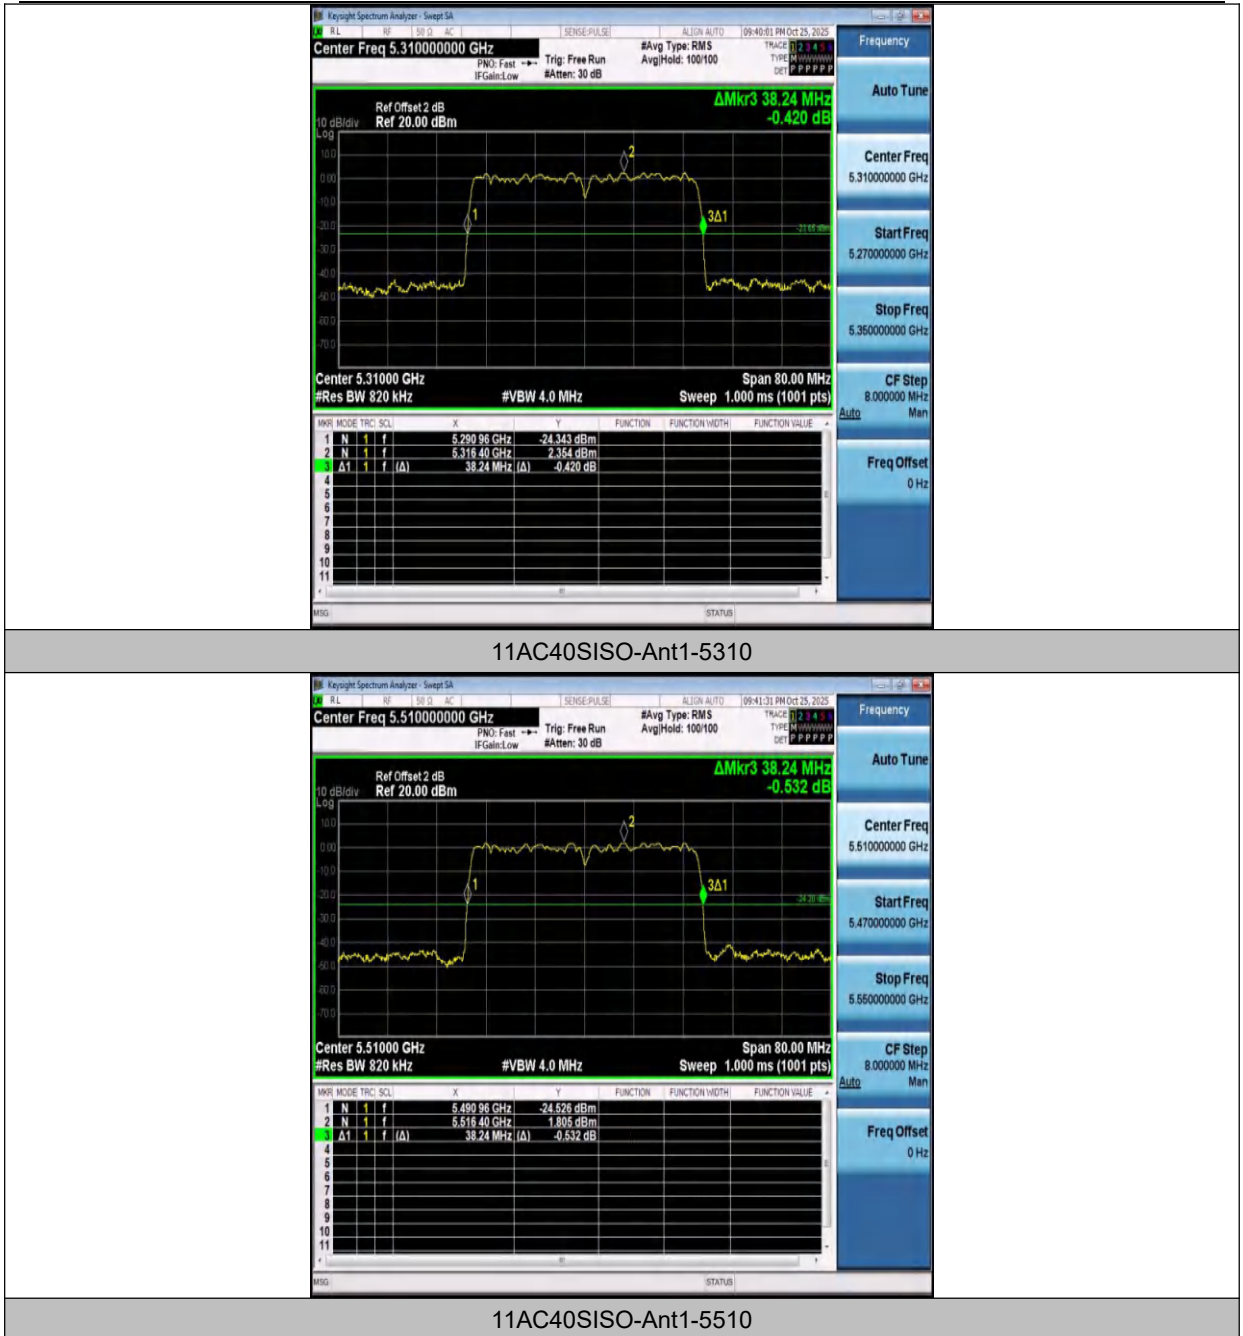


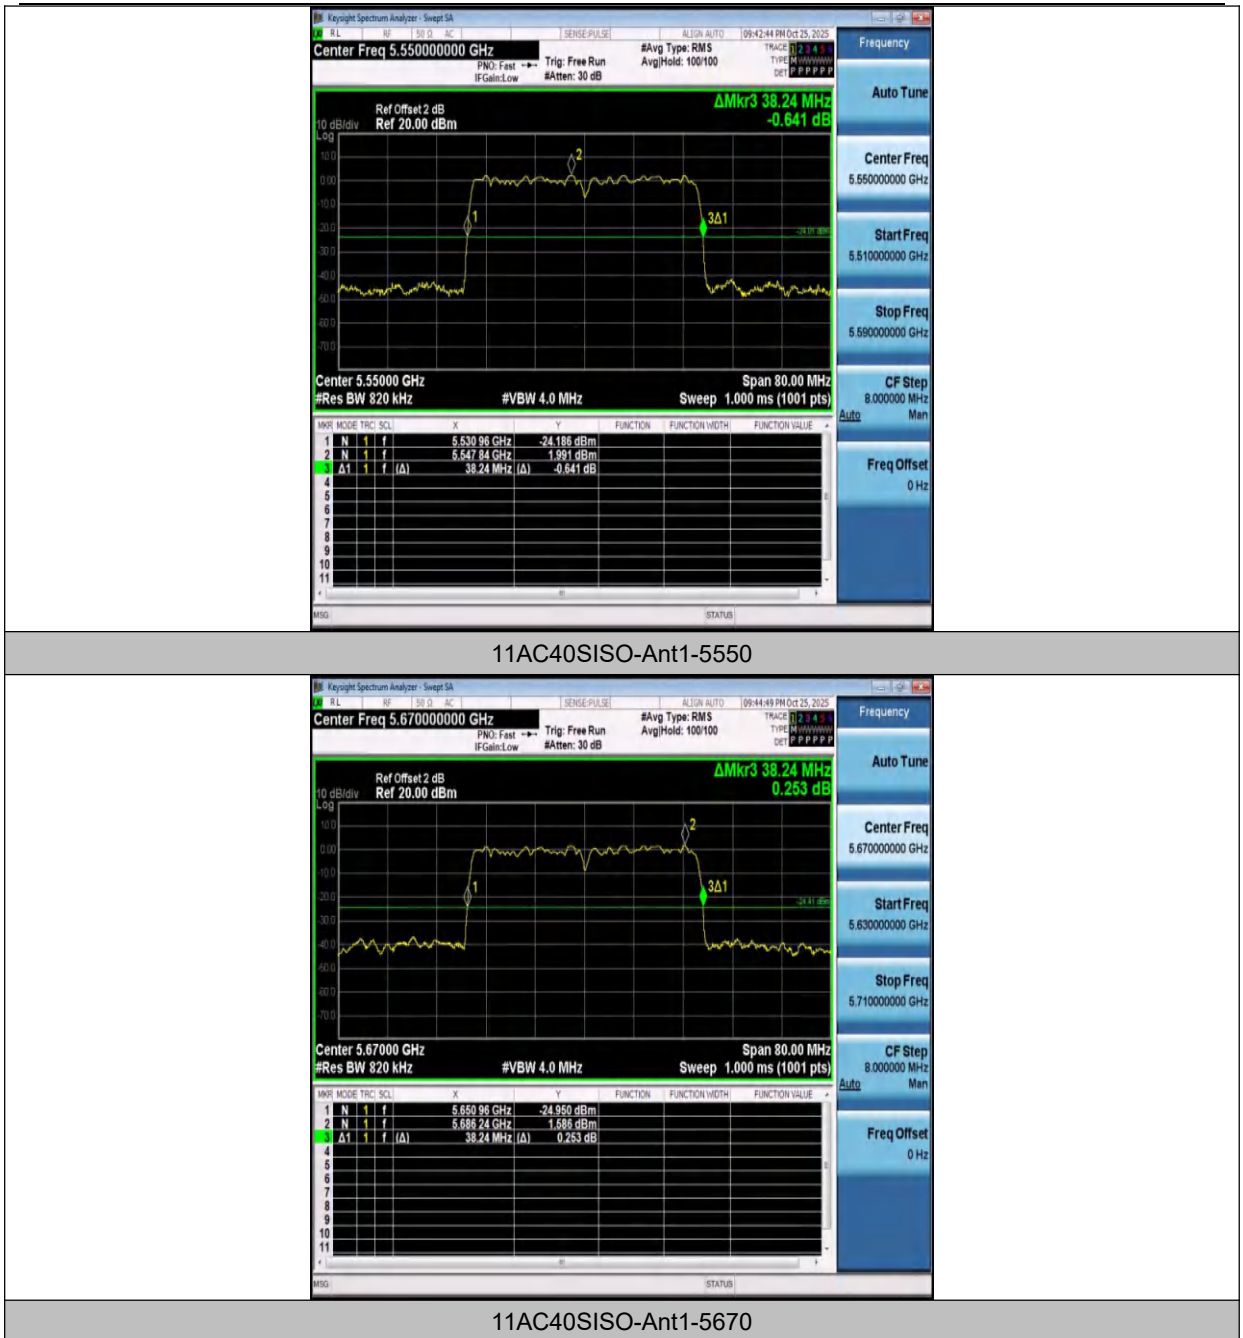

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

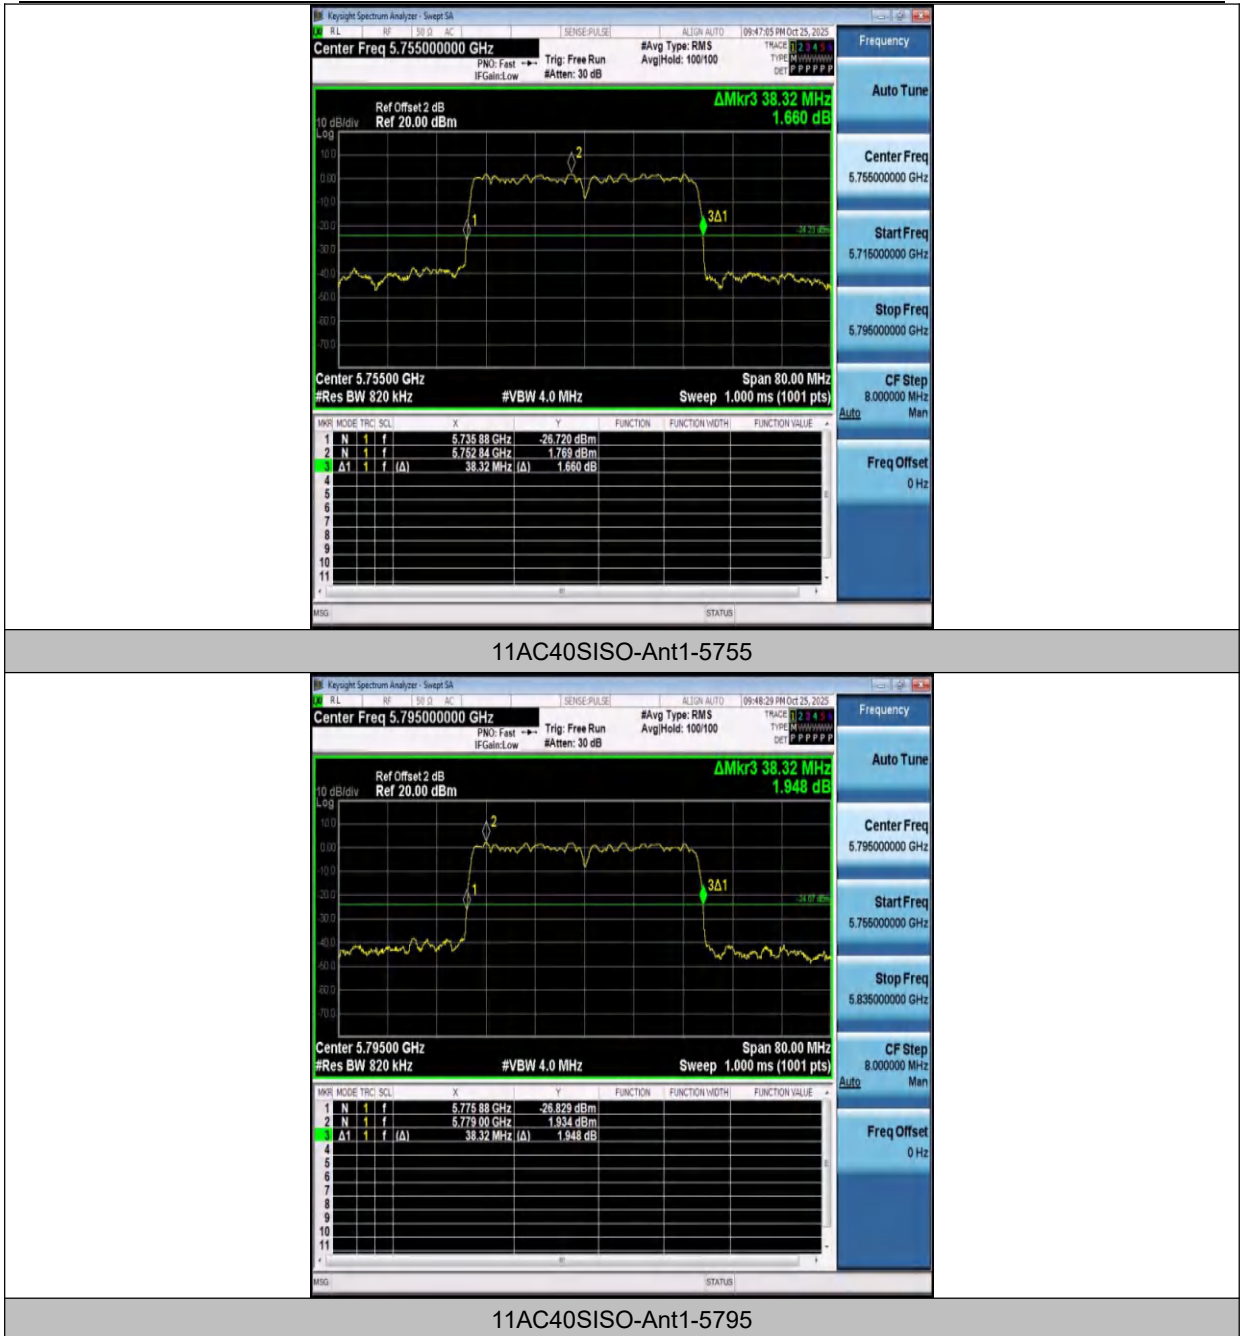


Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

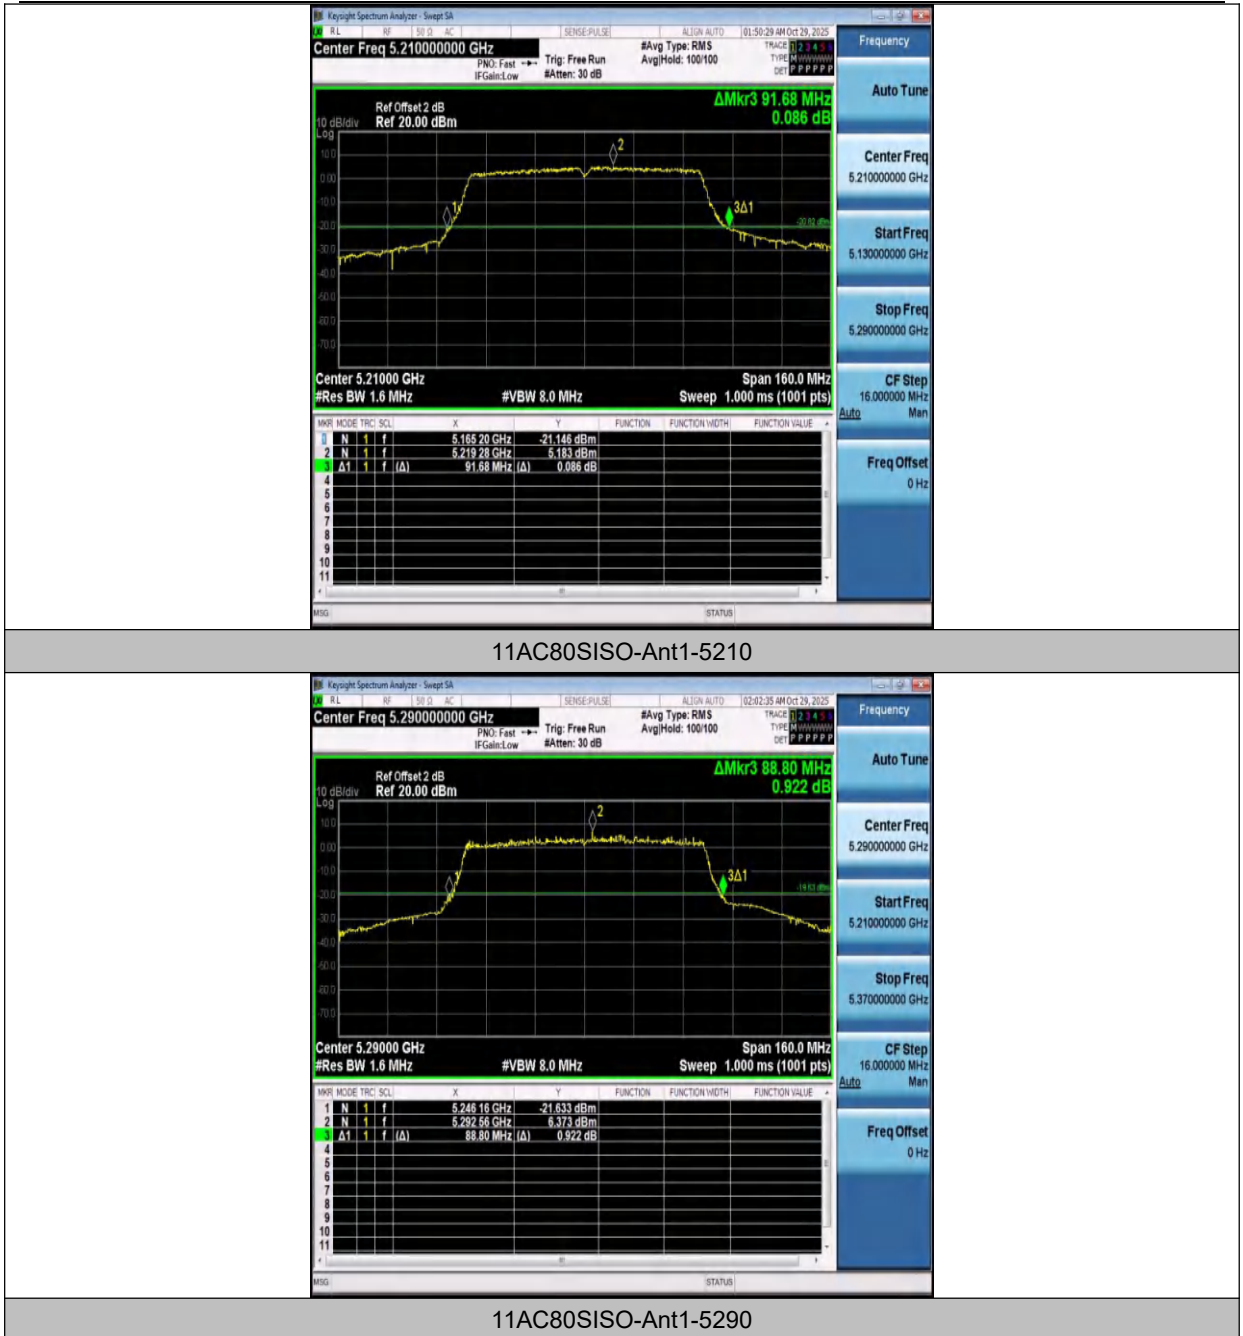



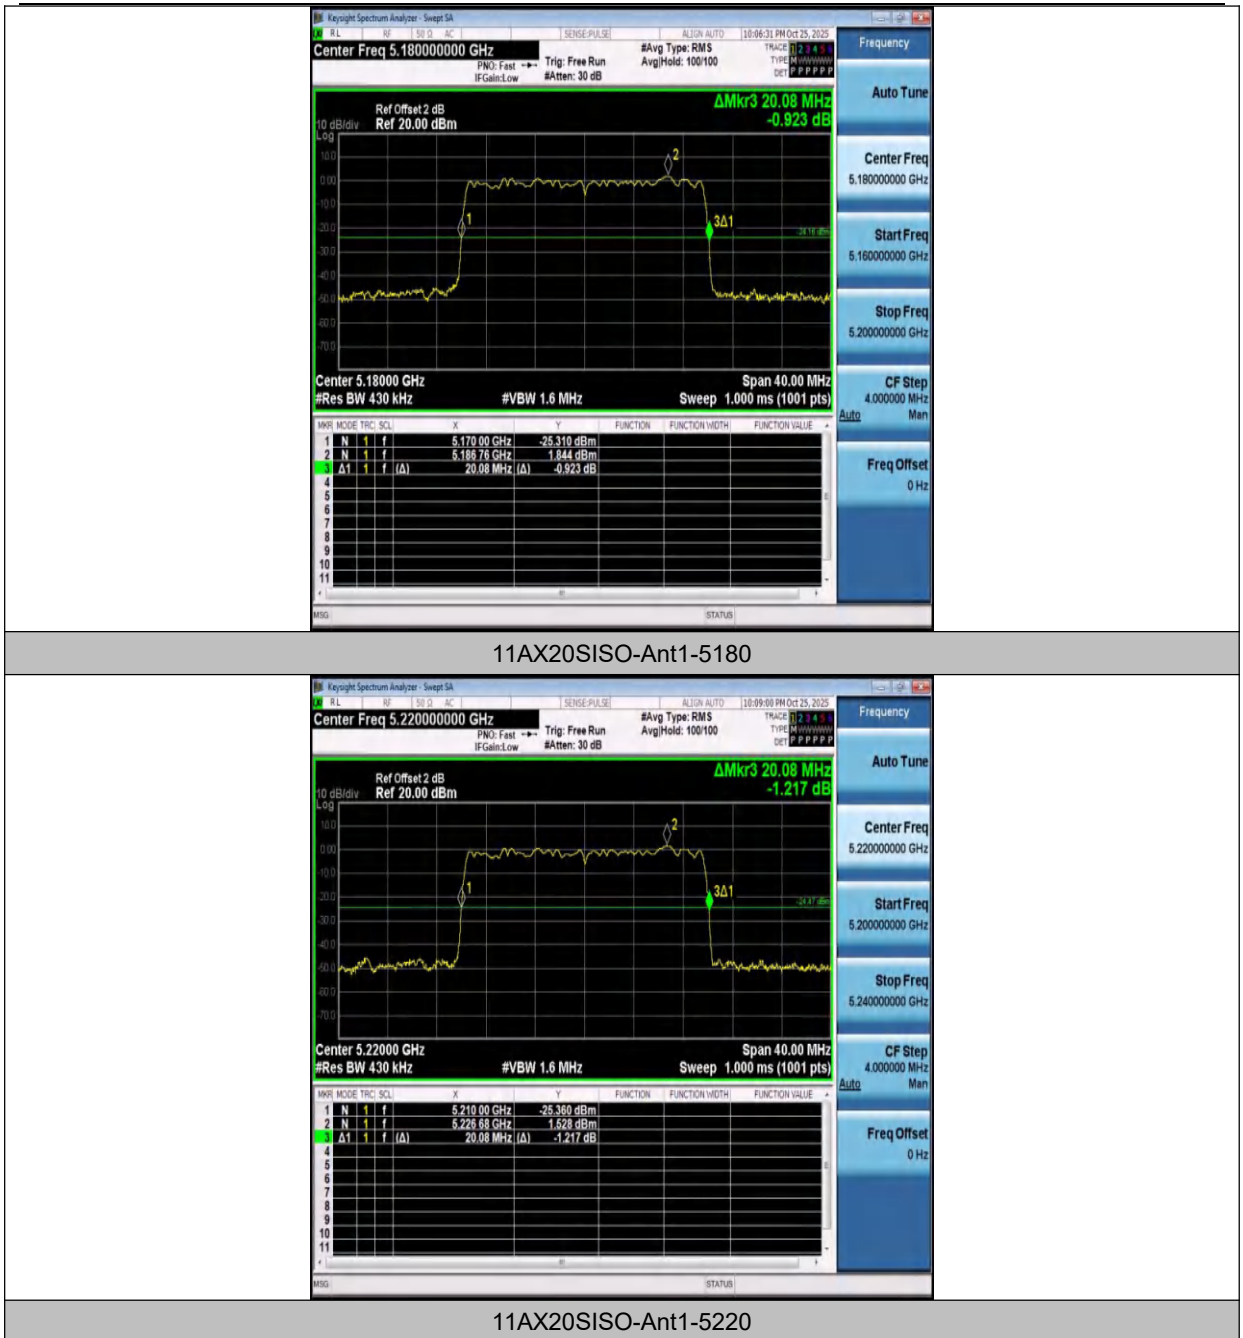

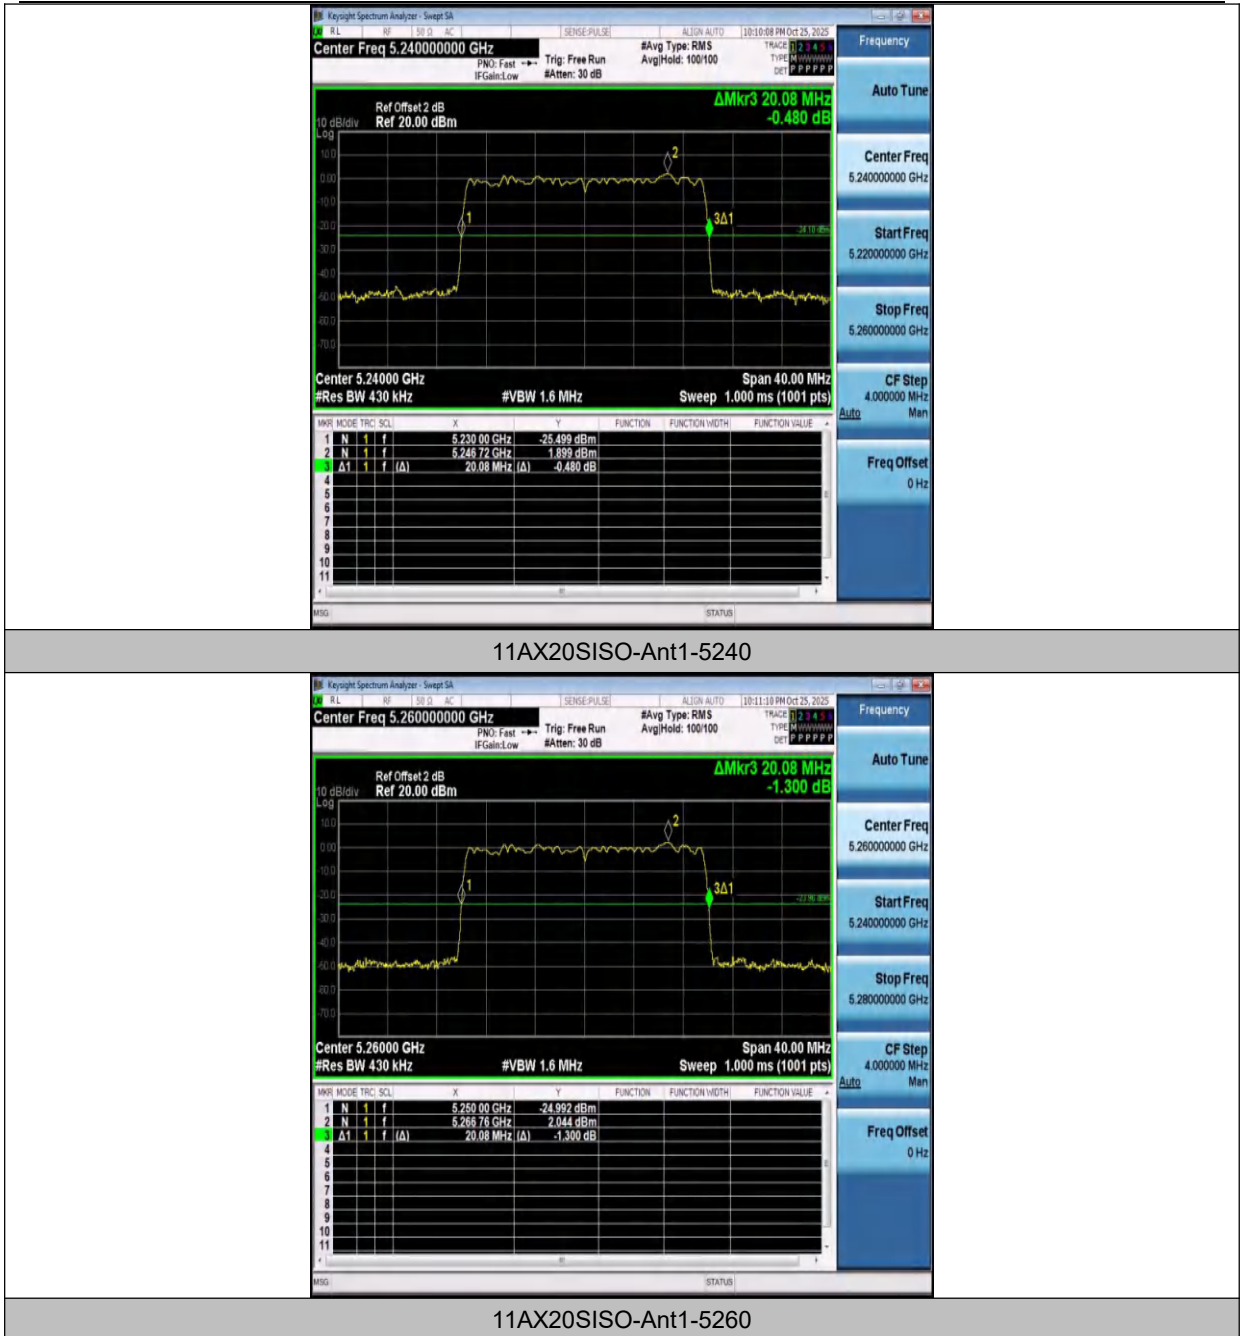



11AX20SISO-Ant1-5300





11AX20SISO-Ant1-5320

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

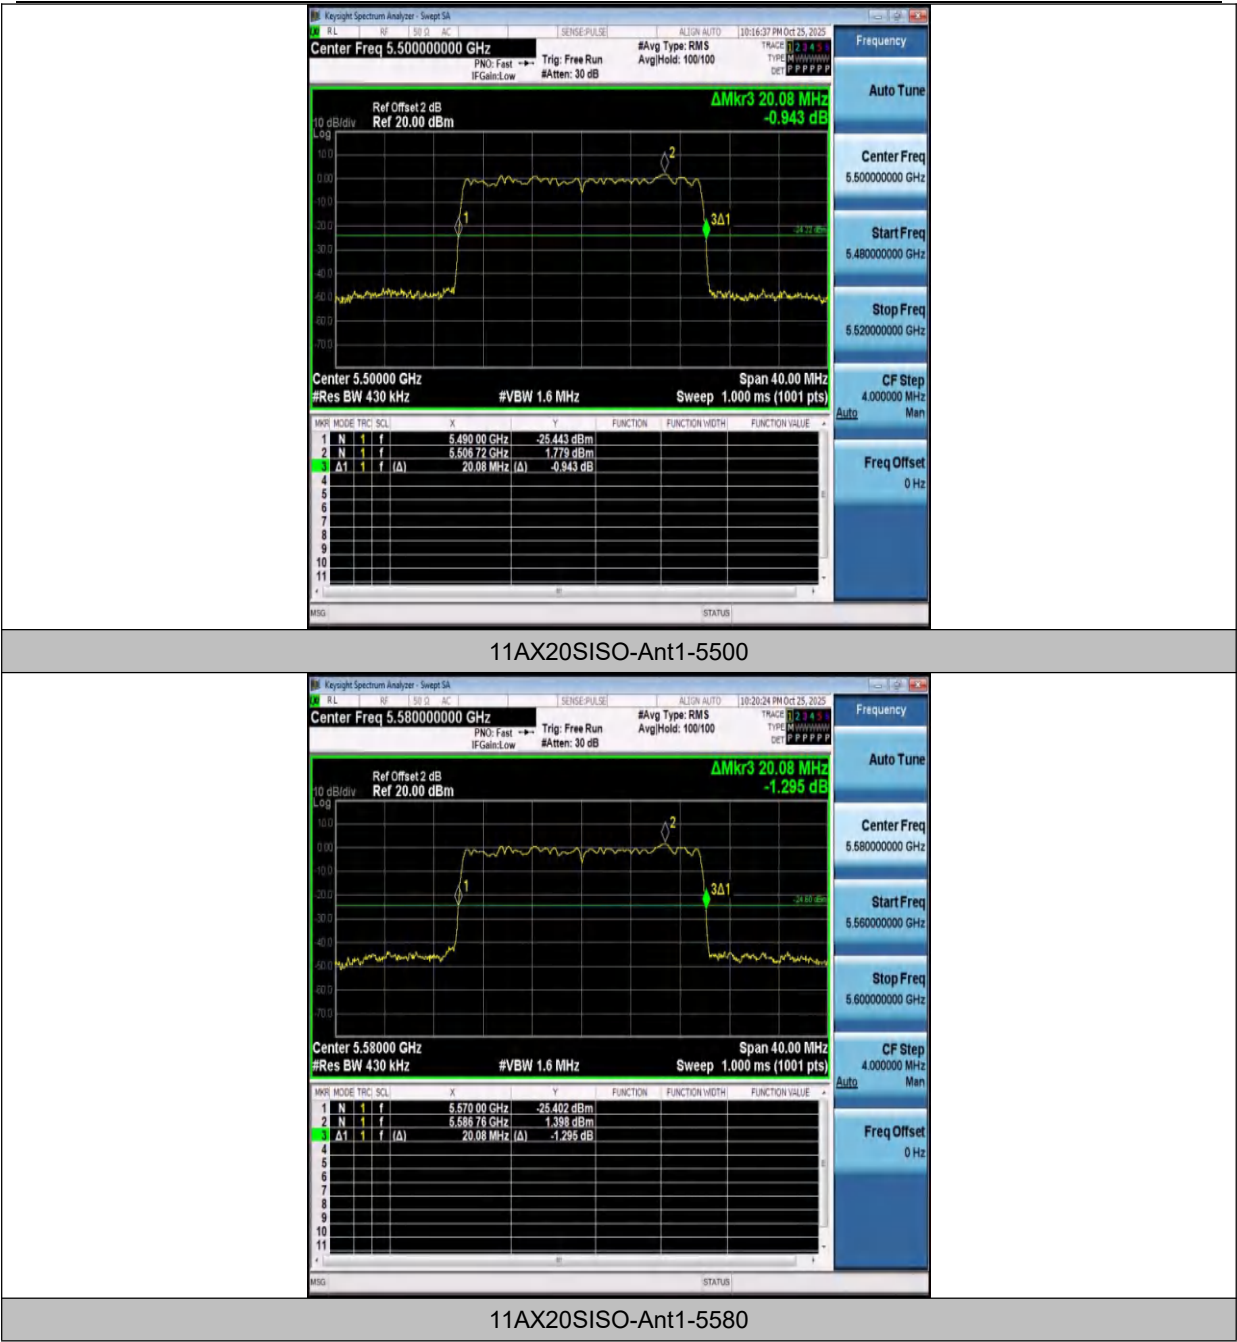

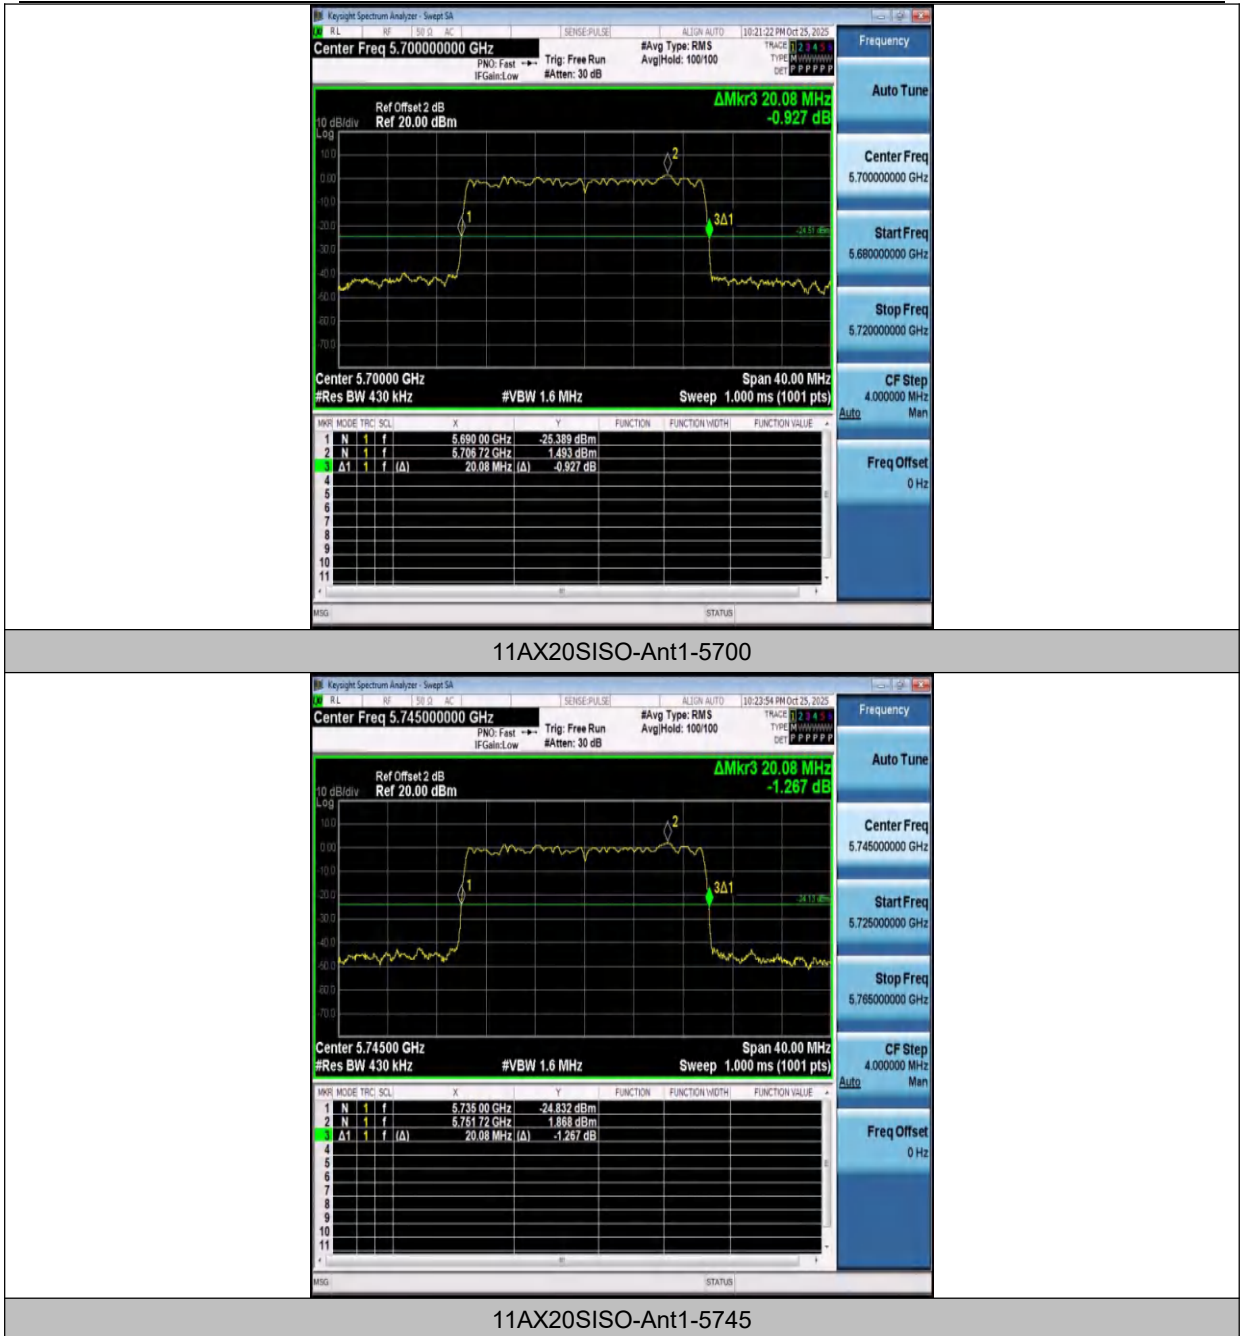





Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

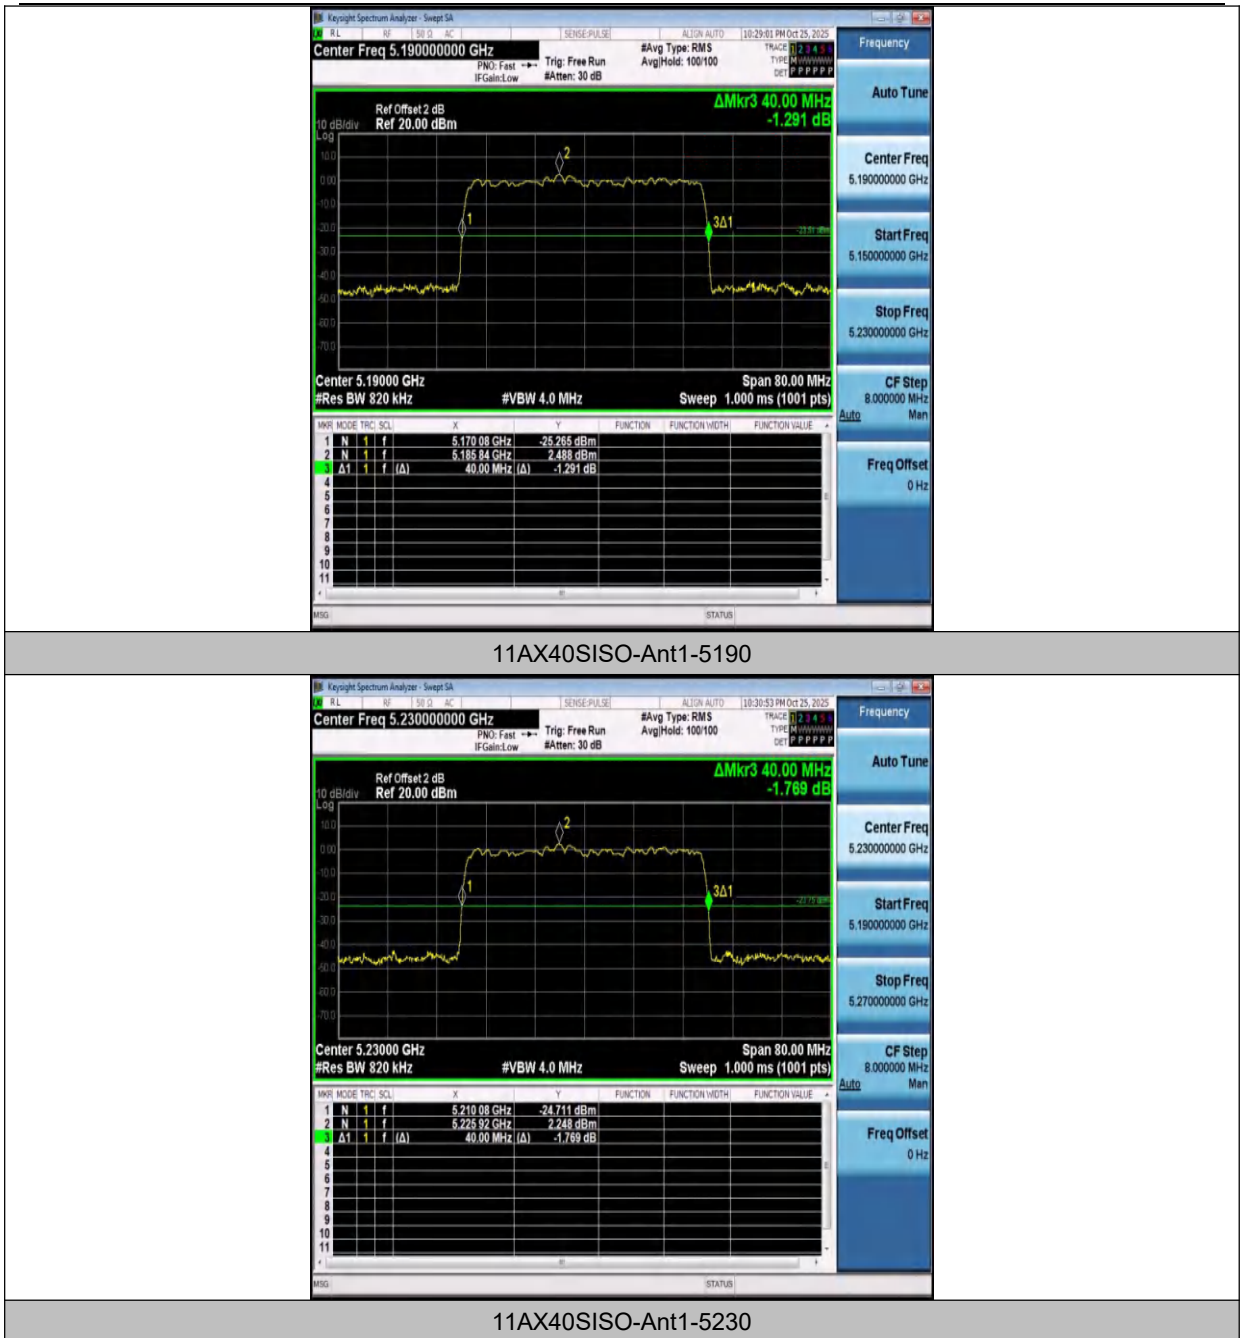


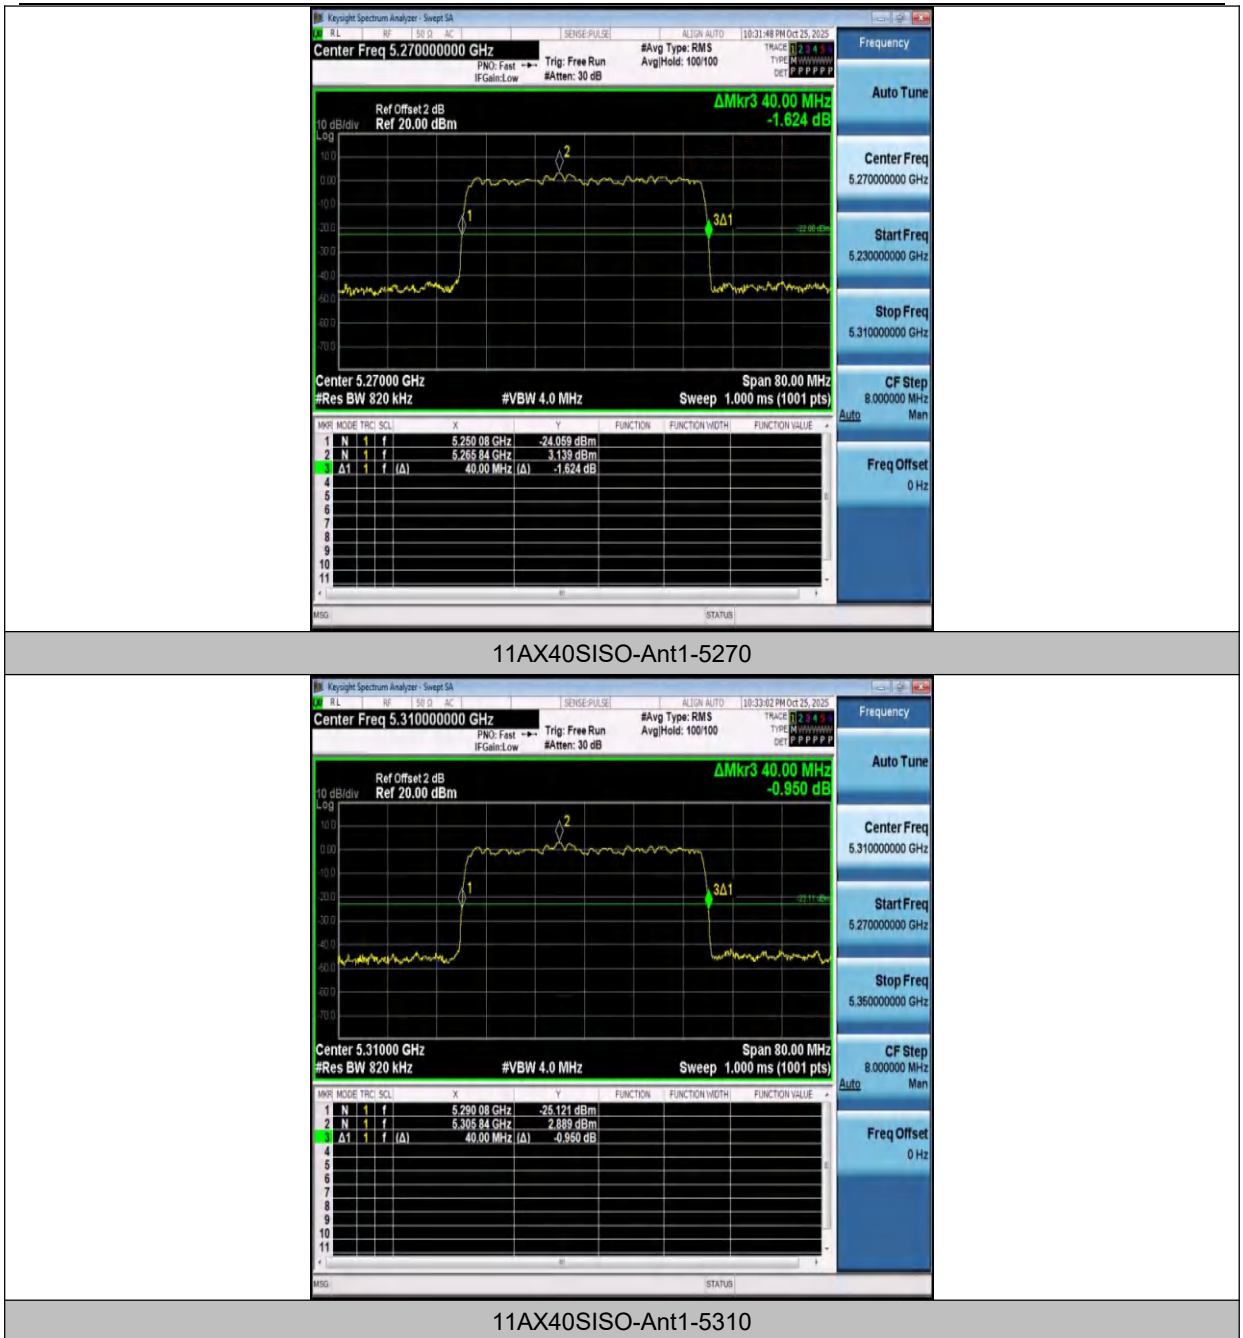



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

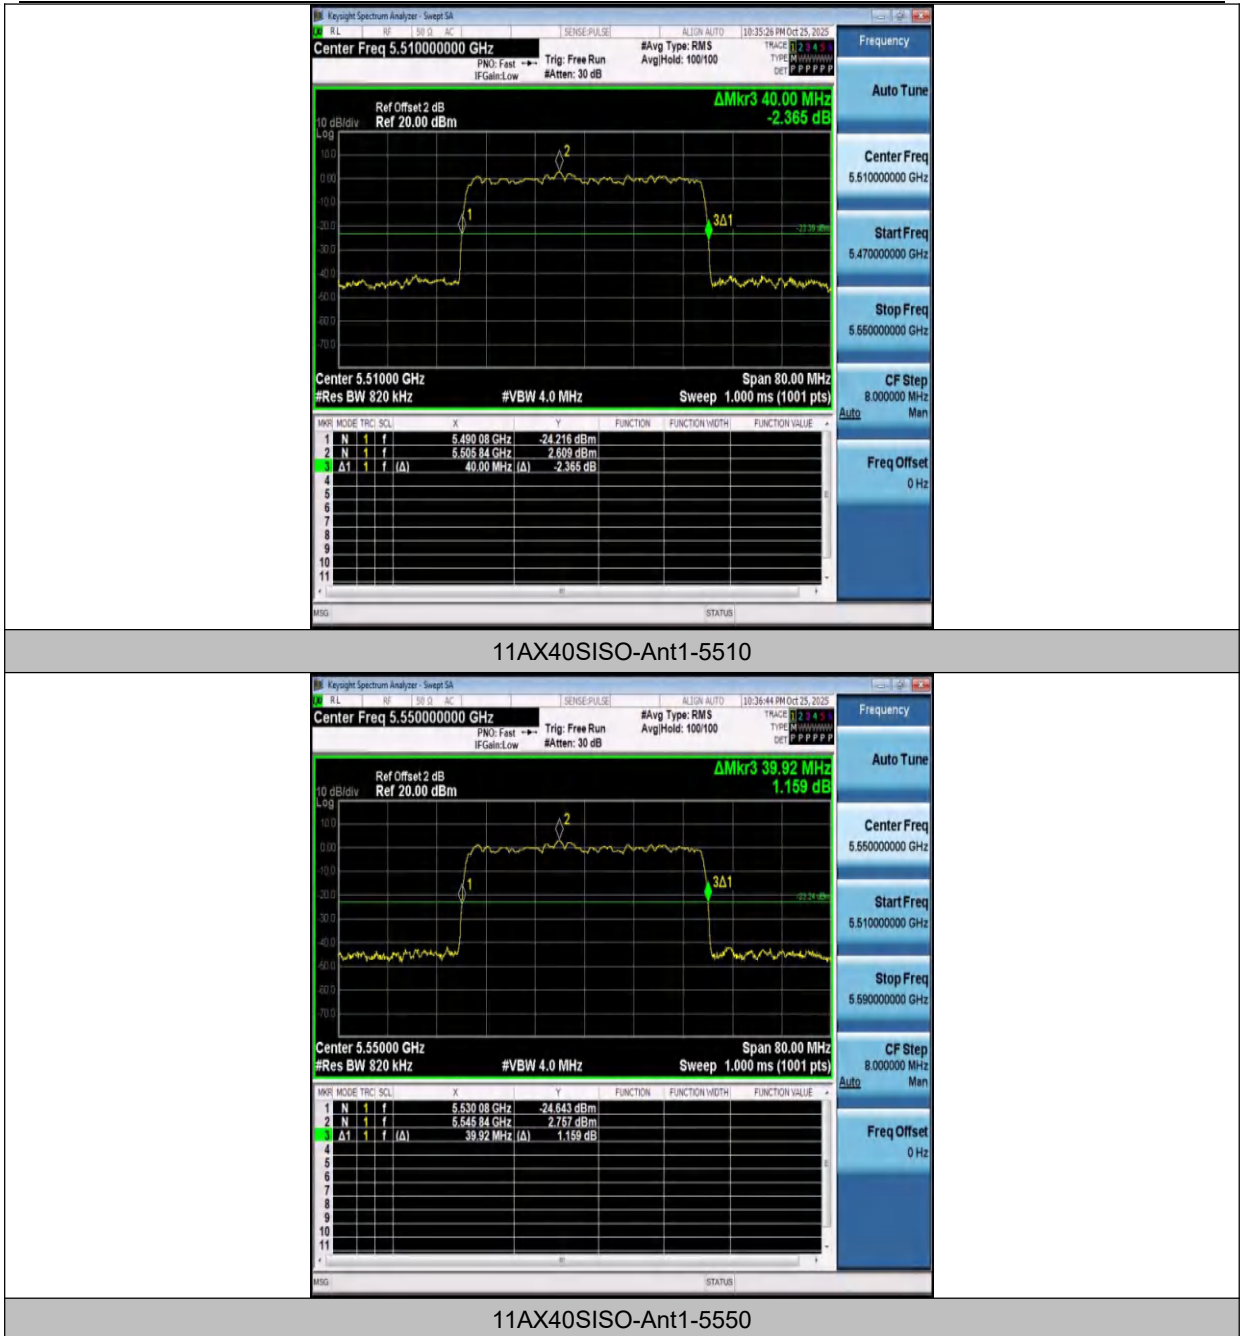

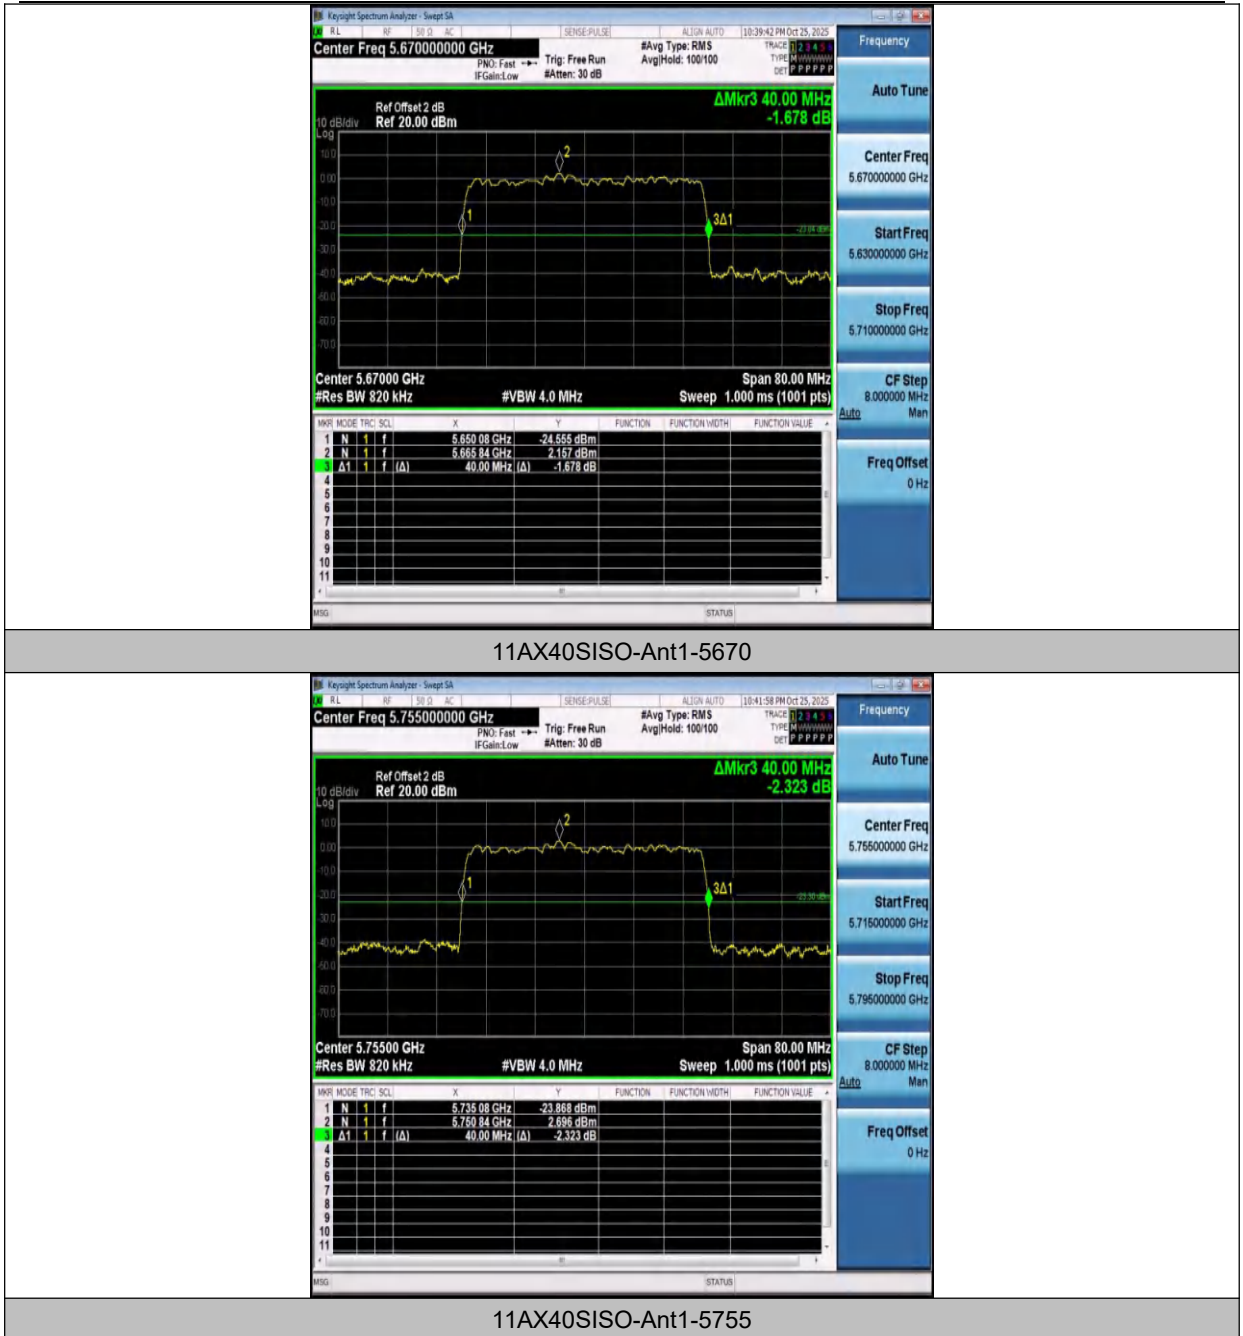

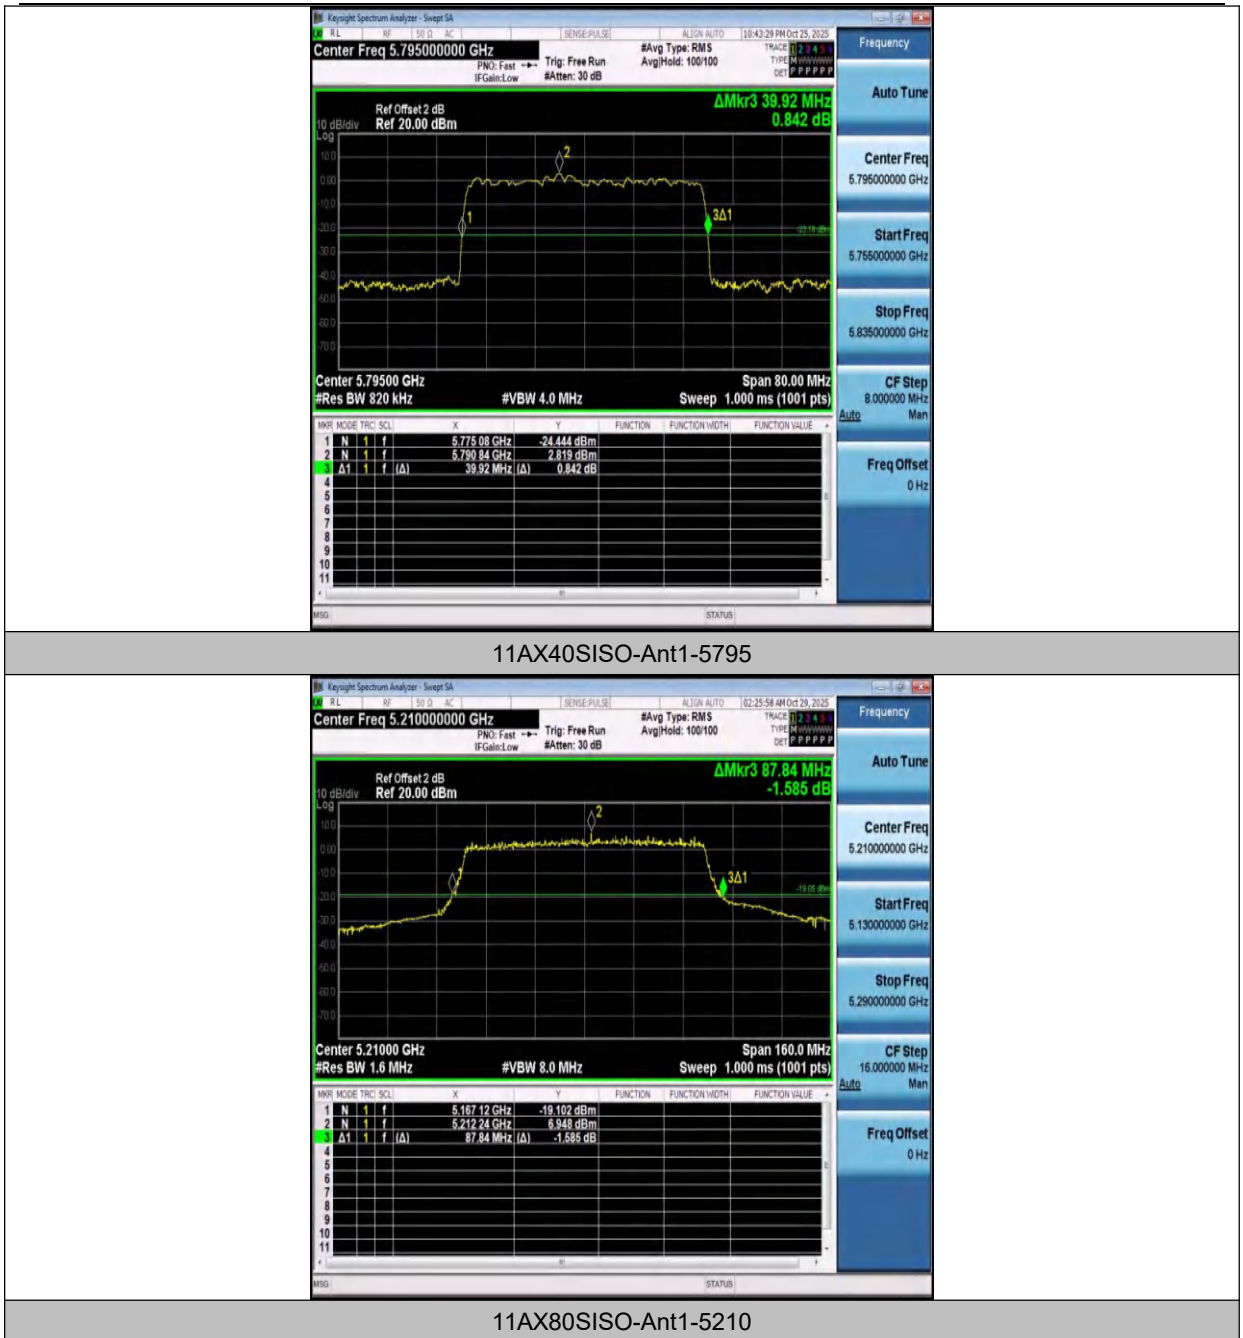





11AX80SISO-Ant1-5775

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix A2: 99% Occupied Bandwidth

Test Result

Test Mode	Antenna	Frequency[MHz]	OCB [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5180	16.407	5171.8401	5188.2471	---	---
11A	Ant1	5220	16.406	5211.8342	5228.2402	---	---
11A	Ant1	5240	16.404	5231.8325	5248.2365	---	---
11A	Ant1	5260	16.404	5251.8312	5268.2352	---	---
11A	Ant1	5300	16.405	5291.8332	5308.2382	---	---
11A	Ant1	5320	16.404	5311.8289	5328.2329	---	---
11A	Ant1	5500	16.407	5491.8244	5508.2314	---	---
11A	Ant1	5580	16.406	5571.8257	5588.2317	---	---
11A	Ant1	5700	16.409	5691.8225	5708.2315	---	---
11A	Ant1	5745	16.408	5736.8220	5753.2300	---	---
11A	Ant1	5785	16.406	5776.8184	5793.2244	---	---
11A	Ant1	5825	16.407	5816.8155	5833.2225	---	---
11N20SISO	Ant1	5180	17.647	5171.2095	5188.8565	---	---
11N20SISO	Ant1	5220	17.648	5211.2081	5228.8561	---	---
11N20SISO	Ant1	5240	17.648	5231.2057	5248.8537	---	---
11N20SISO	Ant1	5260	17.646	5251.2076	5268.8536	---	---
11N20SISO	Ant1	5300	17.647	5291.2098	5308.8568	---	---
11N20SISO	Ant1	5320	17.646	5311.2061	5328.8521	---	---
11N20SISO	Ant1	5500	17.651	5491.2013	5508.8523	---	---
11N20SISO	Ant1	5580	17.650	5571.2028	5588.8528	---	---
11N20SISO	Ant1	5700	17.649	5691.2034	5708.8524	---	---
11N20SISO	Ant1	5745	17.649	5736.2023	5753.8513	---	---
11N20SISO	Ant1	5785	17.651	5776.1966	5793.8476	---	---
11N20SISO	Ant1	5825	17.650	5816.1935	5833.8435	---	---
11N40SISO	Ant1	5190	36.212	5171.9186	5208.1306	---	---
11N40SISO	Ant1	5230	36.214	5211.9179	5248.1319	---	---
11N40SISO	Ant1	5270	36.212	5251.9207	5288.1327	---	---
11N40SISO	Ant1	5310	36.202	5291.9285	5328.1305	---	---
11N40SISO	Ant1	5510	36.215	5491.9142	5528.1292	---	---
11N40SISO	Ant1	5550	36.213	5531.9073	5568.1203	---	---
11N40SISO	Ant1	5670	36.219	5651.9283	5688.1473	---	---
11N40SISO	Ant1	5755	36.218	5736.9018	5773.1198	---	---
11N40SISO	Ant1	5795	36.212	5776.8892	5813.1012	---	---
11AC20SISO	Ant1	5180	17.650	5171.2096	5188.8596	---	---
11AC20SISO	Ant1	5220	17.647	5211.2118	5228.8588	---	---
11AC20SISO	Ant1	5240	17.648	5231.2088	5248.8568	---	---
11AC20SISO	Ant1	5260	17.645	5251.2103	5268.8553	---	---
11AC20SISO	Ant1	5300	17.643	5291.2146	5308.8576	---	---

11AC20SISO	Ant1	5320	17.643	5311.2112	5328.8542	---	---
11AC20SISO	Ant1	5500	17.650	5491.2025	5508.8525	---	---
11AC20SISO	Ant1	5580	17.648	5571.2050	5588.8530	---	---
11AC20SISO	Ant1	5700	17.657	5691.1992	5708.8562	---	---
11AC20SISO	Ant1	5745	17.658	5736.1967	5753.8547	---	---
11AC20SISO	Ant1	5785	17.651	5776.1998	5793.8508	---	---
11AC20SISO	Ant1	5825	17.654	5816.1919	5833.8459	---	---
11AC40SISO	Ant1	5190	36.215	5171.9219	5208.1369	---	---
11AC40SISO	Ant1	5230	36.221	5211.9217	5248.1427	---	---
11AC40SISO	Ant1	5270	36.214	5251.9287	5288.1427	---	---
11AC40SISO	Ant1	5310	36.203	5291.9282	5328.1312	---	---
11AC40SISO	Ant1	5510	36.213	5491.9132	5528.1262	---	---
11AC40SISO	Ant1	5550	36.212	5531.9066	5568.1186	---	---
11AC40SISO	Ant1	5670	36.215	5651.9256	5688.1406	---	---
11AC40SISO	Ant1	5755	36.218	5736.8996	5773.1176	---	---
11AC40SISO	Ant1	5795	36.214	5776.8848	5813.0988	---	---
11AC80SISO	Ant1	5210	76.465	5172.2002	5248.6652	---	---
11AC80SISO	Ant1	5290	77.913	5251.3469	5329.2599	---	---
11AC80SISO	Ant1	5530	78.344	5491.0968	5569.4408	---	---
11AC80SISO	Ant1	5775	78.199	5736.1268	5814.3258	---	---
11AX20SISO	Ant1	5180	19.099	5170.4849	5189.5839	---	---
11AX20SISO	Ant1	5220	19.097	5210.4912	5229.5882	---	---
11AX20SISO	Ant1	5240	19.094	5230.4893	5249.5833	---	---
11AX20SISO	Ant1	5260	19.098	5250.4854	5269.5834	---	---
11AX20SISO	Ant1	5300	19.097	5290.4922	5309.5892	---	---
11AX20SISO	Ant1	5320	19.094	5310.4895	5329.5835	---	---
11AX20SISO	Ant1	5500	19.095	5490.4853	5509.5803	---	---
11AX20SISO	Ant1	5580	19.096	5570.4858	5589.5818	---	---
11AX20SISO	Ant1	5700	19.096	5690.4841	5709.5801	---	---
11AX20SISO	Ant1	5745	19.098	5735.4804	5754.5784	---	---
11AX20SISO	Ant1	5785	19.096	5775.4792	5794.5752	---	---
11AX20SISO	Ant1	5825	19.098	5815.4741	5834.5721	---	---
11AX40SISO	Ant1	5190	37.827	5171.1658	5208.9928	---	---
11AX40SISO	Ant1	5230	37.836	5211.1600	5248.9960	---	---
11AX40SISO	Ant1	5270	37.818	5251.1709	5288.9889	---	---
11AX40SISO	Ant1	5310	37.826	5291.1631	5328.9891	---	---
11AX40SISO	Ant1	5510	37.837	5491.1428	5528.9798	---	---
11AX40SISO	Ant1	5550	37.837	5531.1365	5568.9735	---	---
11AX40SISO	Ant1	5670	37.834	5651.1648	5688.9988	---	---
11AX40SISO	Ant1	5755	37.839	5736.1364	5773.9754	---	---
11AX40SISO	Ant1	5795	37.834	5776.1175	5813.9515	---	---
11AX80SISO	Ant1	5210	78.057	5171.3952	5249.4522	---	---

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

11AX80SISO	Ant1	5290	77.853	5251.4578	5329.3108	---	---
11AX80SISO	Ant1	5530	78.338	5491.0933	5569.4313	---	---
11AX80SISO	Ant1	5775	78.146	5736.0462	5814.1922	---	---

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Test Graphs



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

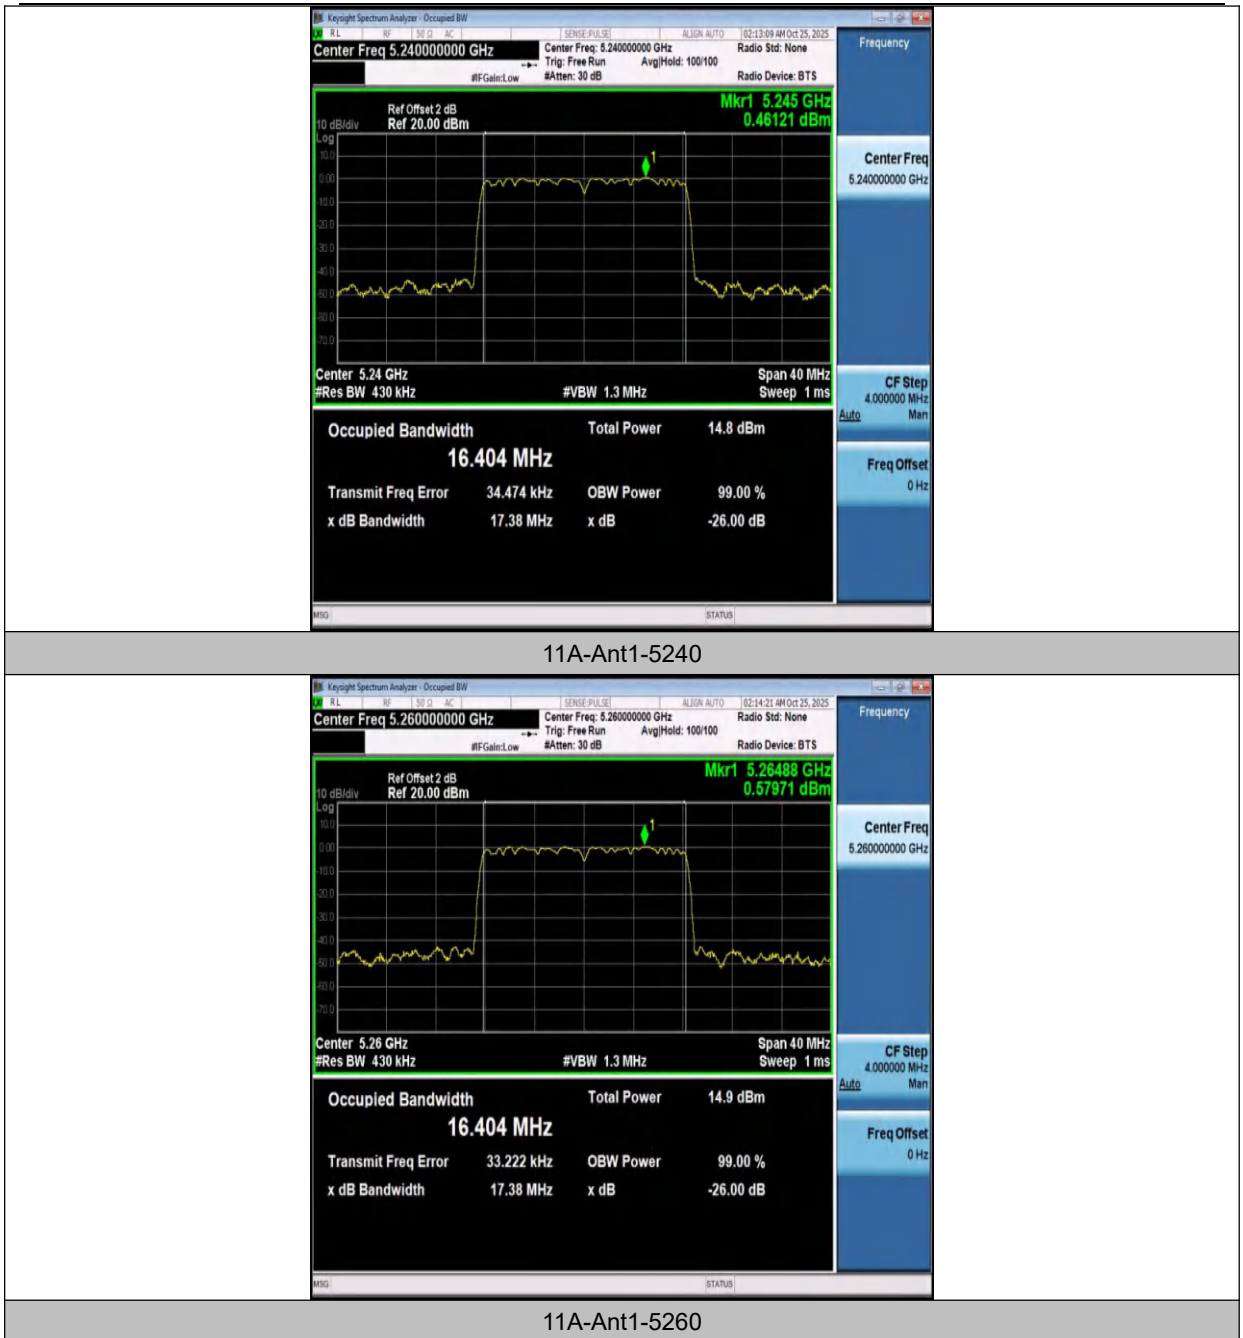

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

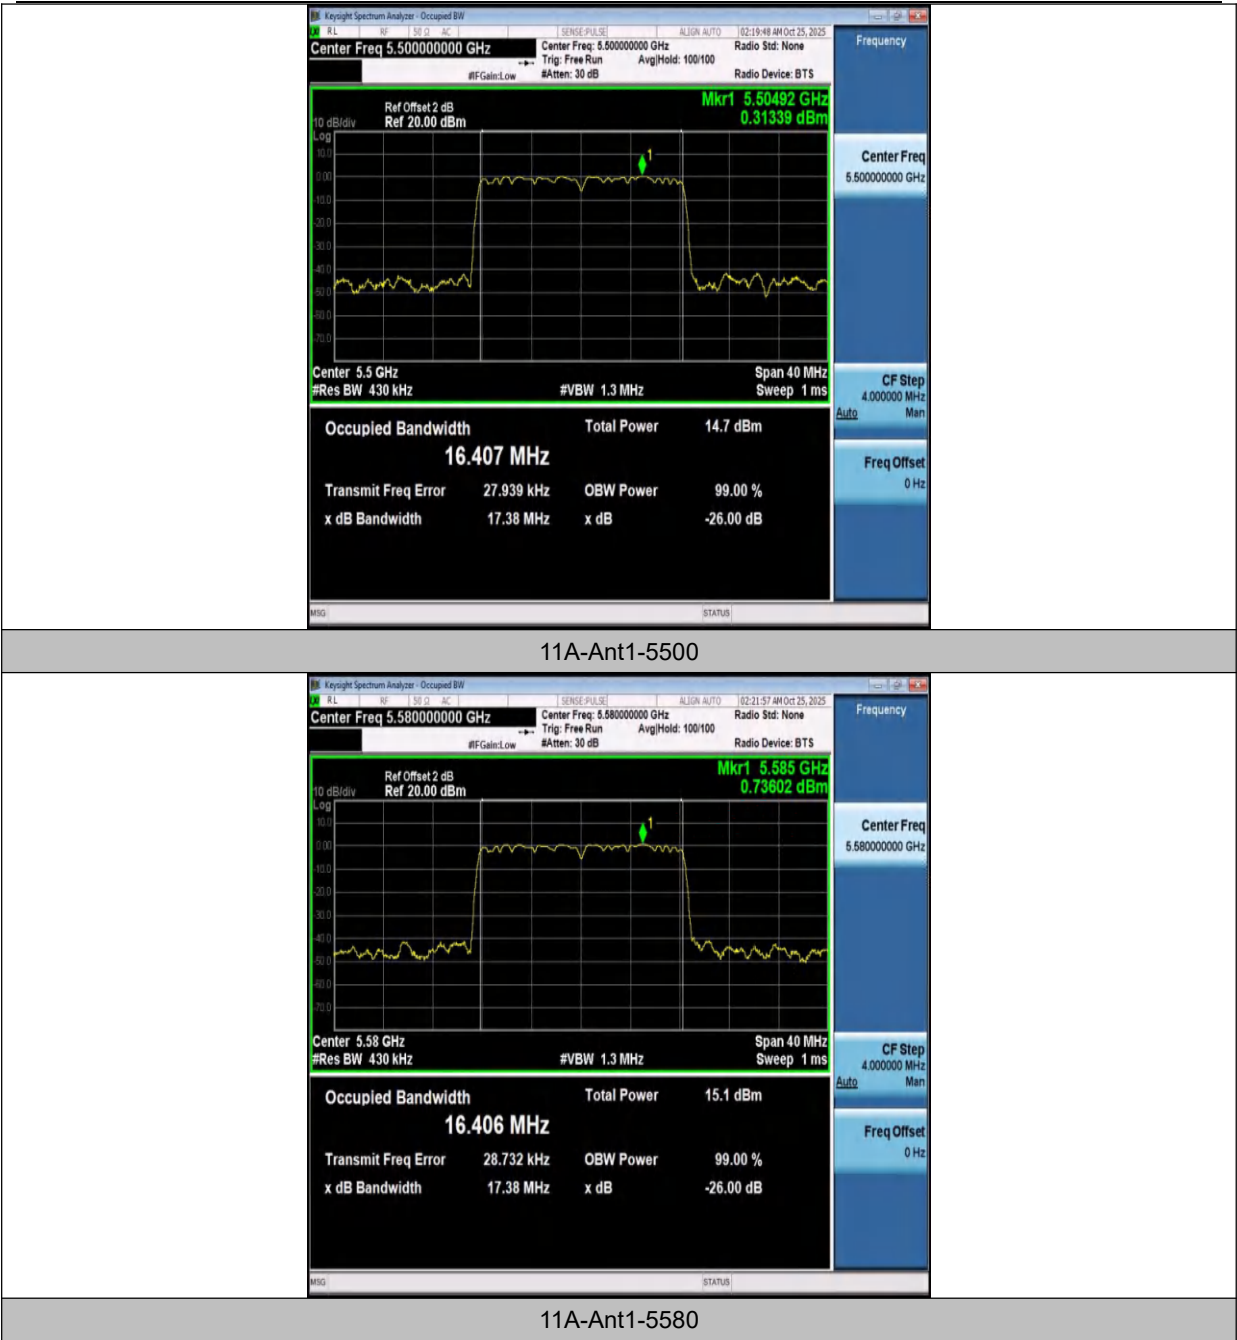

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

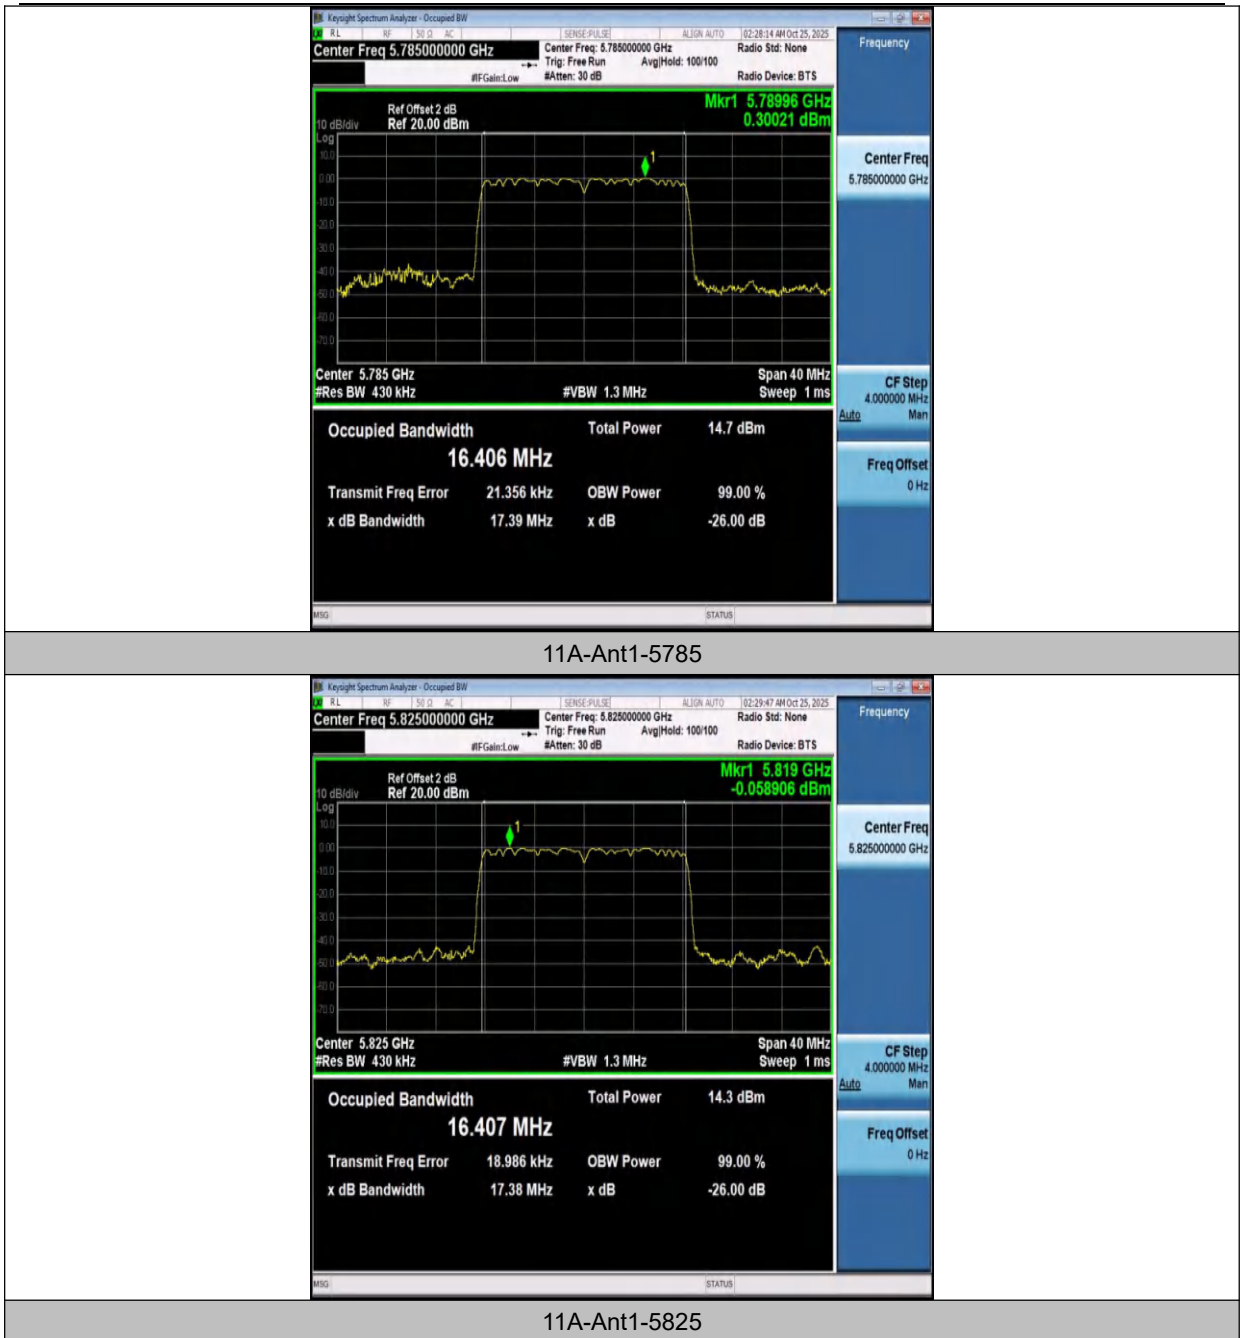

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

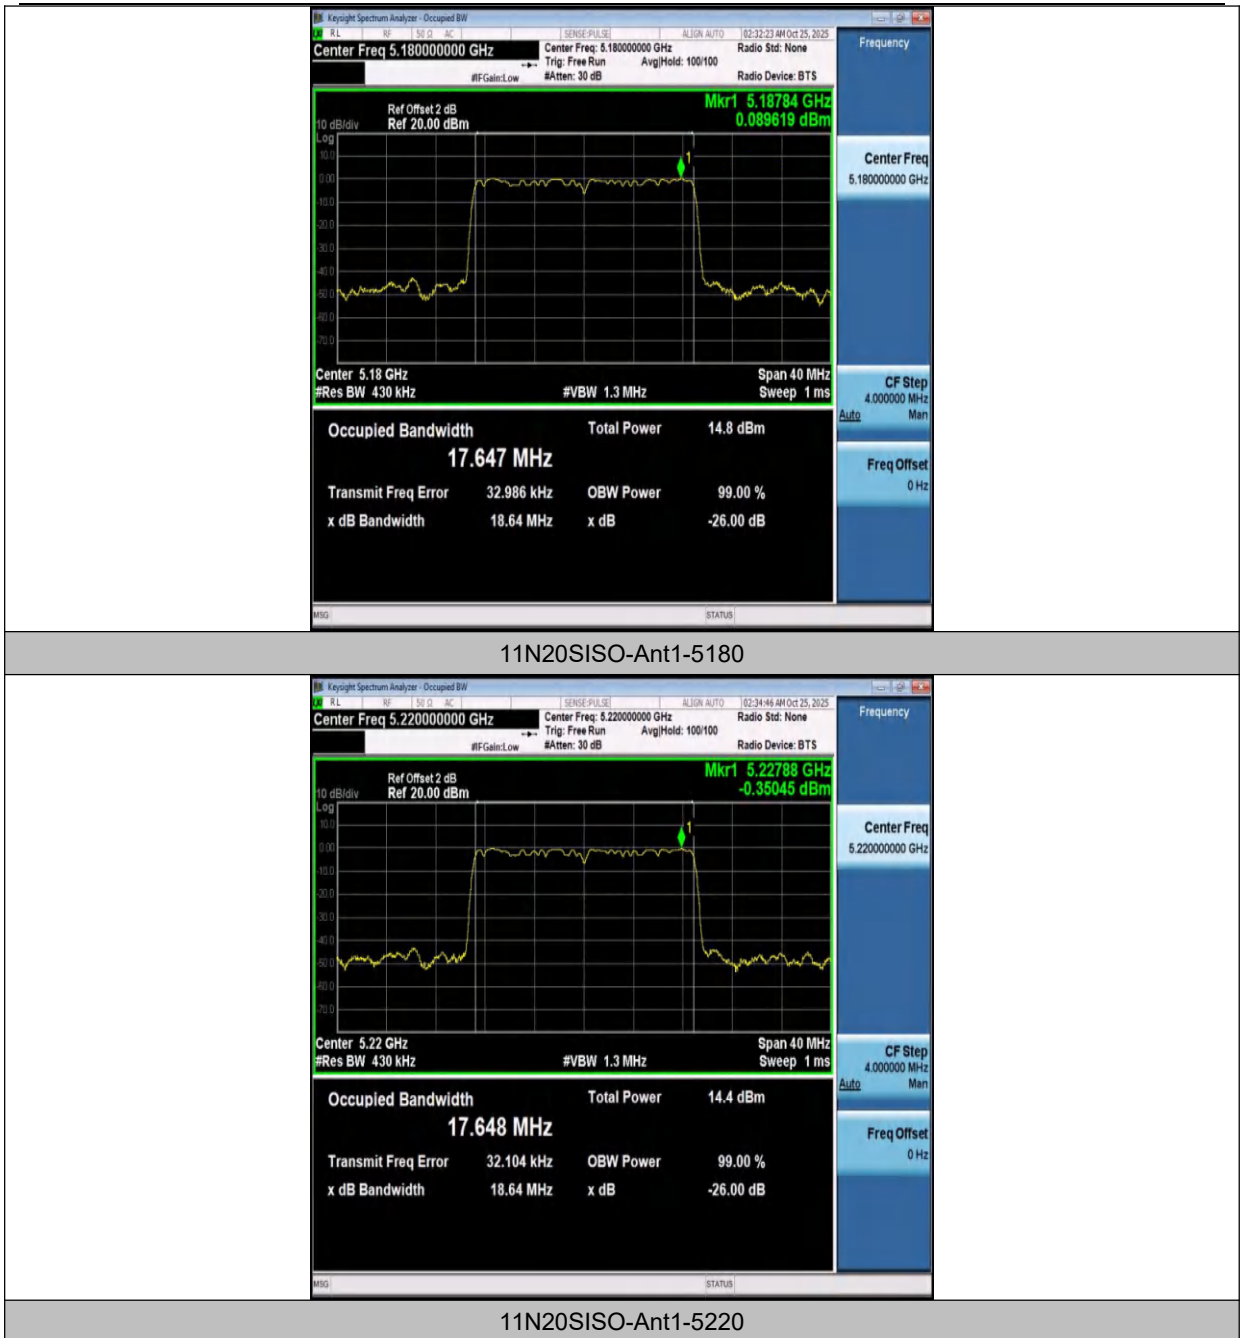

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com