



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

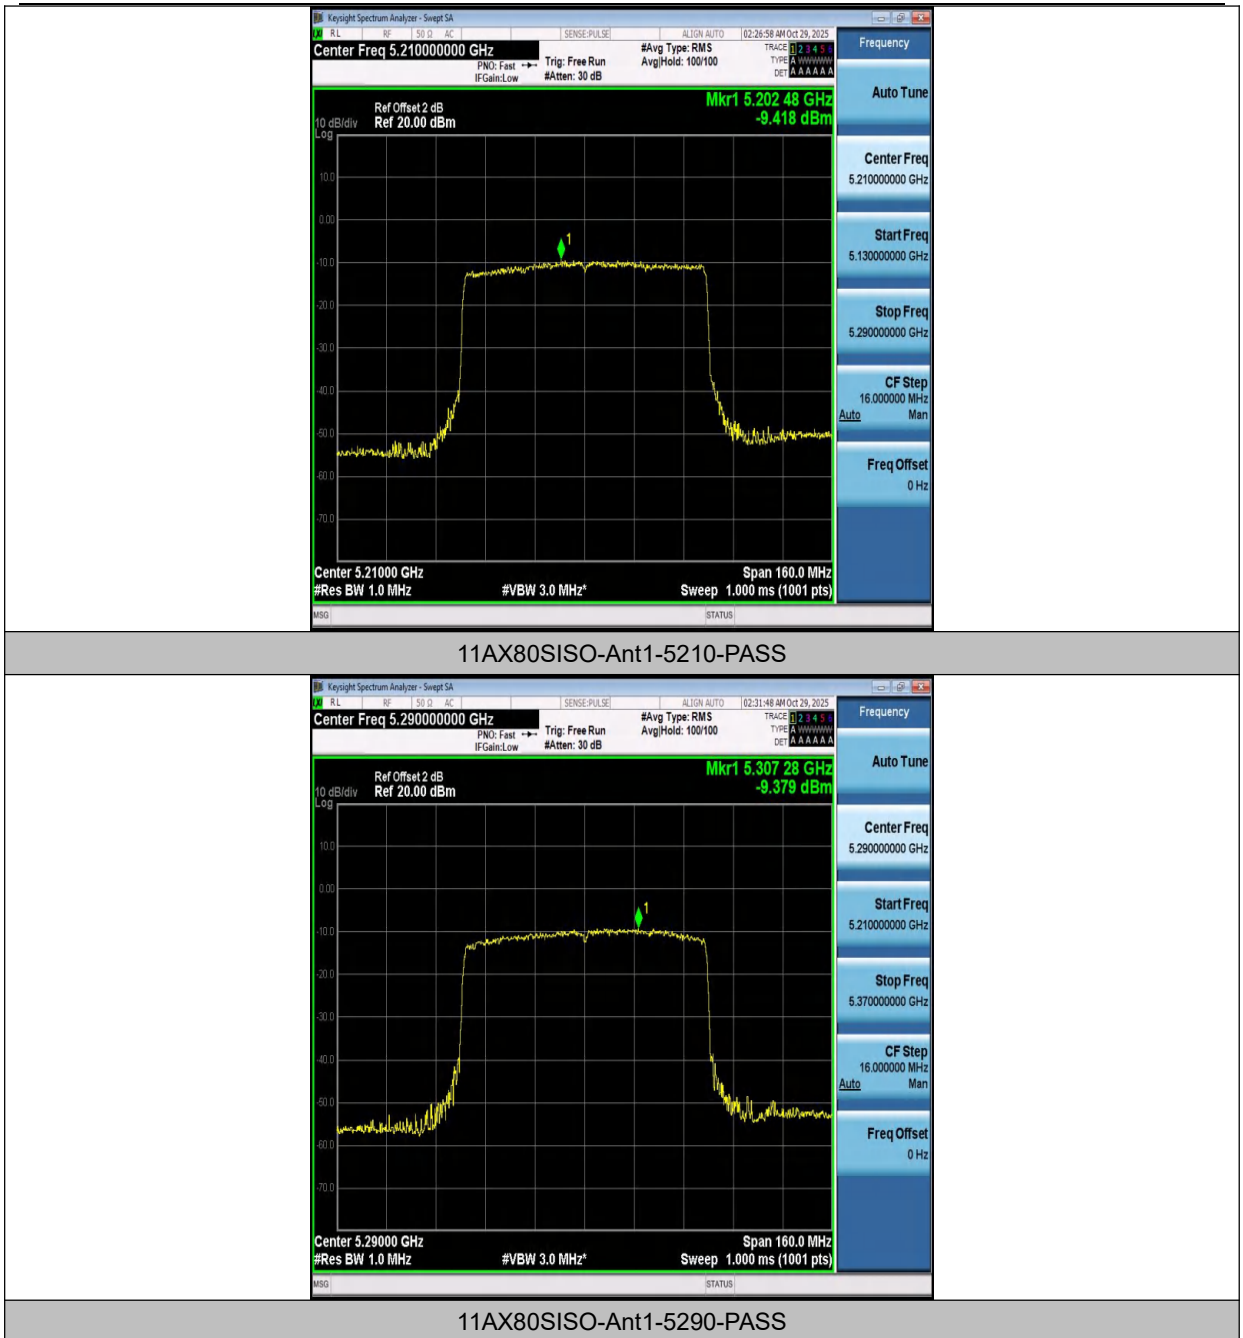

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

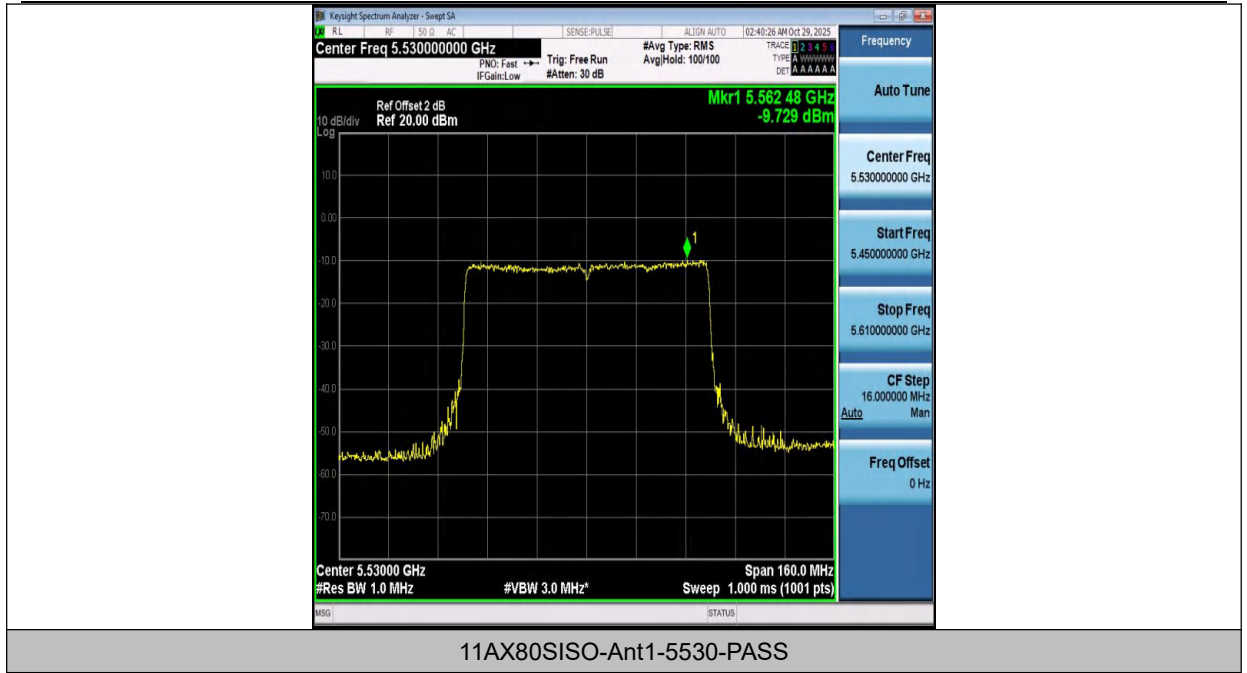

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Test GraphsB4



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

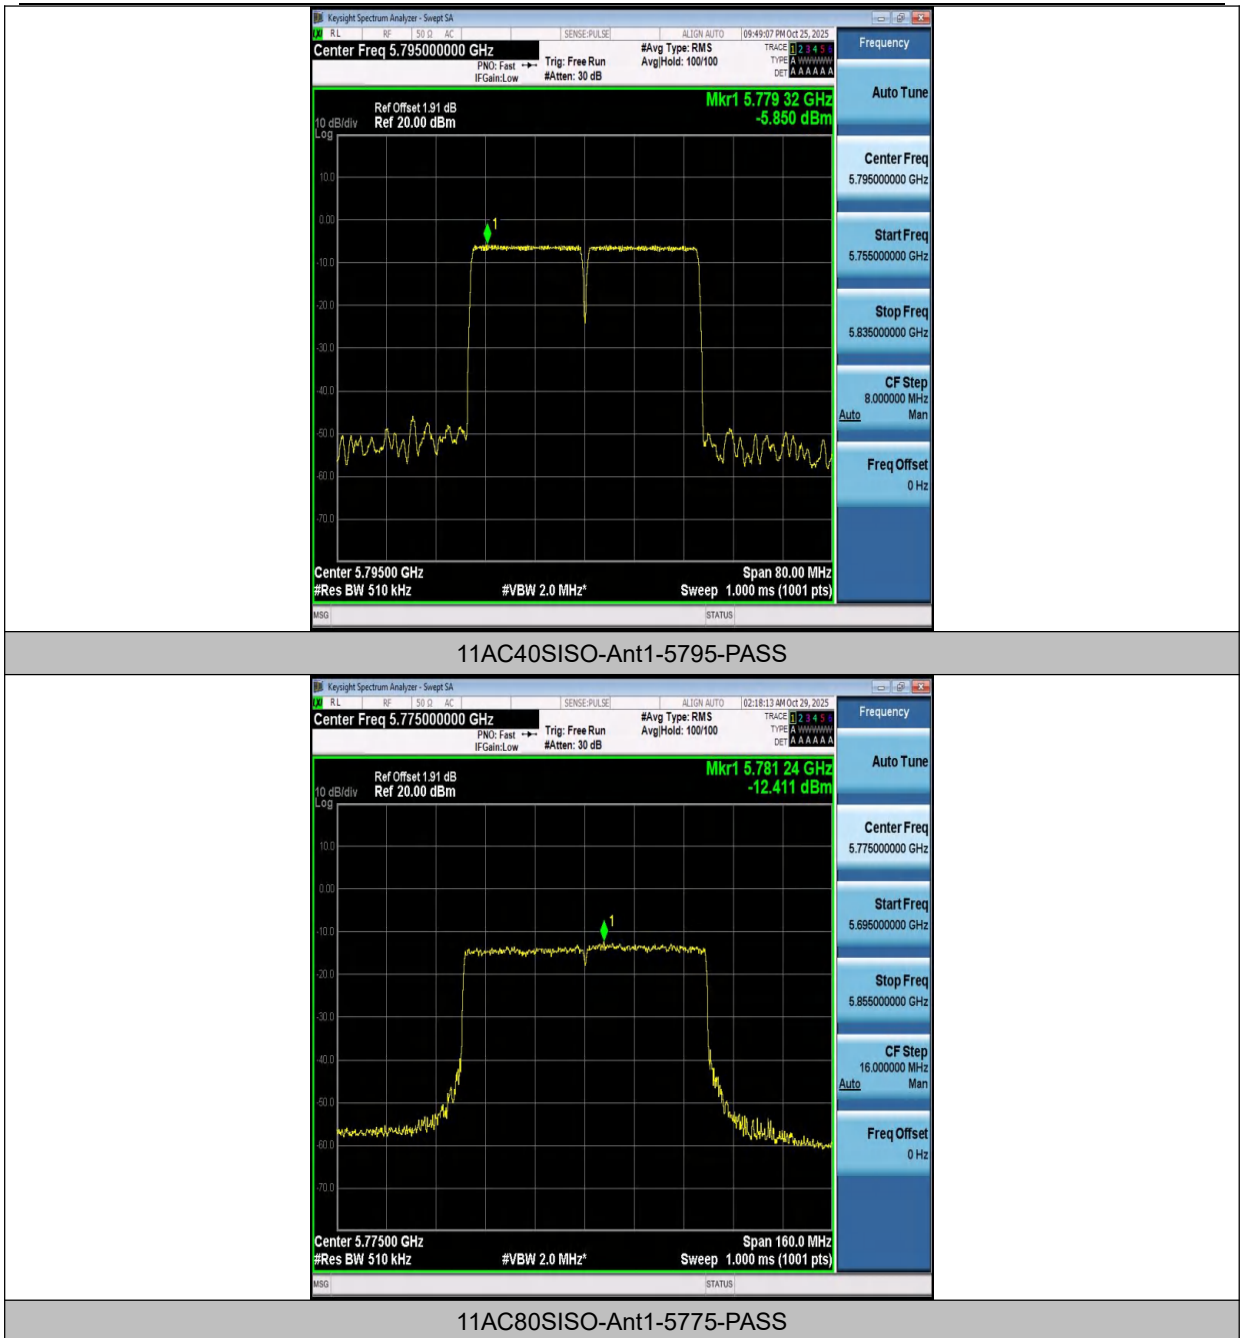

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

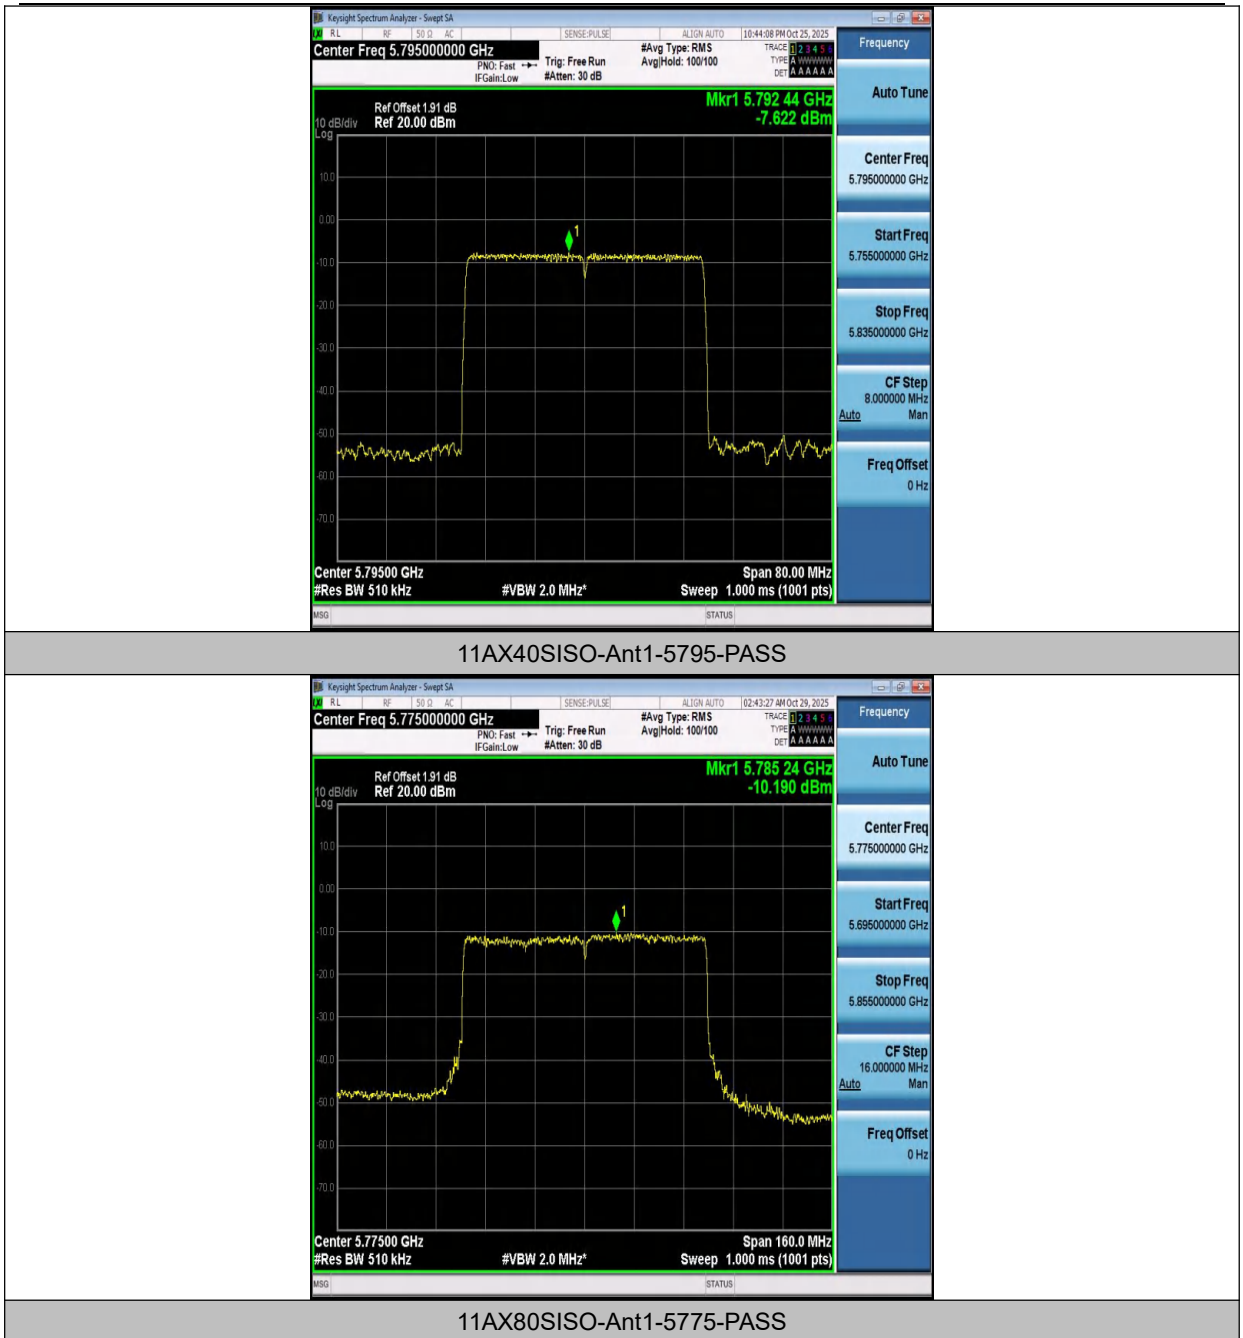

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix E: Band edge measurements

Test Result B1/2/3

Test Mode	Antenna	Ch Name	Frequency[MHz]	Result[dBm]	Limit[dBm]	Verdict
11A	Ant1	Low	5180	-44.47	≤-27	PASS
11A	Ant1	High	5320	-39.73	≤-27	PASS
11A	Ant1	Low	5500	-37.7	≤-27	PASS
11A	Ant1	High	5700	-35.57	≤-27	PASS
11N20SISO	Ant1	Low	5180	-43.67	≤-27	PASS
11N20SISO	Ant1	High	5320	-41.39	≤-27	PASS
11N20SISO	Ant1	Low	5500	-39.16	≤-27	PASS
11N20SISO	Ant1	High	5700	-35.44	≤-27	PASS
11N40SISO	Ant1	Low	5190	-42.71	≤-27	PASS
11N40SISO	Ant1	High	5310	-38.78	≤-27	PASS
11N40SISO	Ant1	Low	5510	-38.93	≤-27	PASS
11N40SISO	Ant1	High	5670	-36.95	≤-27	PASS
11AC20SISO	Ant1	Low	5180	-43.67	≤-27	PASS
11AC20SISO	Ant1	High	5320	-42.53	≤-27	PASS
11AC20SISO	Ant1	Low	5500	-38.27	≤-27	PASS
11AC20SISO	Ant1	High	5700	-35.54	≤-27	PASS
11AC40SISO	Ant1	Low	5190	-43.91	≤-27	PASS
11AC40SISO	Ant1	High	5310	-38.97	≤-27	PASS
11AC40SISO	Ant1	Low	5510	-41.31	≤-27	PASS
11AC40SISO	Ant1	High	5670	-39.29	≤-27	PASS
11AC80SISO	Ant1	Low	5210	-33.26	≤-27	PASS
11AC80SISO	Ant1	High	5290	-28.27	≤-27	PASS
11AC80SISO	Ant1	Low	5530	-31.38	≤-27	PASS
11AX20SISO	Ant1	Low	5180	-43.9	≤-27	PASS
11AX20SISO	Ant1	High	5320	-40.96	≤-27	PASS
11AX20SISO	Ant1	Low	5500	-42	≤-27	PASS
11AX20SISO	Ant1	High	5700	-36.49	≤-27	PASS
11AX40SISO	Ant1	Low	5190	-43.15	≤-27	PASS
11AX40SISO	Ant1	High	5310	-40.55	≤-27	PASS
11AX40SISO	Ant1	Low	5510	-37.62	≤-27	PASS
11AX40SISO	Ant1	High	5670	-37.5	≤-27	PASS
11AX80SISO	Ant1	Low	5210	-33.37	≤-27	PASS
11AX80SISO	Ant1	High	5290	-28.33	≤-27	PASS
11AX80SISO	Ant1	Low	5530	-31.19	≤-27	PASS

Note: 1.The Antenna gain and cable loss are compensated in the graph.

Test Result B4

Test Mode	Antenna	Ch. Name	Frequency[M Hz]	FreqRange [MHz]	Result [dBm]	Limit [dBm]	Verdict
11A	Ant1	Low	5745	5720~5725	-38.49	≤16.08	PASS
11A	Ant1	Low	5745	5700~5720	-38.76	≤12.63	PASS
11A	Ant1	Low	5745	5650~5700	-46.3	≤-26.96	PASS
11A	Ant1	Low	5745	5760~5650	-43.61	≤-27	PASS
11A	Ant1	High	5825	5850~5855	-40.21	≤17.57	PASS
11A	Ant1	High	5825	5855~5875	-41.86	≤11.38	PASS
11A	Ant1	High	5825	5875~5925	-45.22	≤-26.71	PASS
11A	Ant1	High	5825	5925~5935	-45.37	≤-27	PASS
11N20SISO	Ant1	Low	5745	5720~5725	-35.96	≤16.08	PASS
11N20SISO	Ant1	Low	5745	5700~5720	-38.34	≤11.44	PASS
11N20SISO	Ant1	Low	5745	5650~5700	-45.01	≤-26.70	PASS
11N20SISO	Ant1	Low	5745	5760~5650	-44.37	≤-27	PASS
11N20SISO	Ant1	High	5825	5850~5855	-41.3	≤16.34	PASS
11N20SISO	Ant1	High	5825	5855~5875	-40.25	≤10.55	PASS
11N20SISO	Ant1	High	5825	5875~5925	-46.13	≤-26.51	PASS
11N20SISO	Ant1	High	5825	5925~5935	-44	≤-27	PASS
11N40SISO	Ant1	Low	5755	5720~5725	-37.63	≤15.74	PASS
11N40SISO	Ant1	Low	5755	5700~5720	-37.42	≤10.78	PASS
11N40SISO	Ant1	Low	5755	5650~5700	-46.22	≤-26.80	PASS
11N40SISO	Ant1	Low	5755	5780~5650	-44.77	≤-27	PASS
11N40SISO	Ant1	High	5795	5850~5855	-43.54	≤16.41	PASS
11N40SISO	Ant1	High	5795	5855~5875	-43.69	≤11.36	PASS
11N40SISO	Ant1	High	5795	5875~5925	-46.15	≤-25.73	PASS
11N40SISO	Ant1	High	5795	5925~5935	-44.84	≤-27	PASS
11AC20SISO	Ant1	Low	5745	5720~5725	-40.35	≤15.82	PASS
11AC20SISO	Ant1	Low	5745	5700~5720	-40.43	≤10.06	PASS
11AC20SISO	Ant1	Low	5745	5650~5700	-43.82	≤-26.96	PASS
11AC20SISO	Ant1	Low	5745	5760~5650	-45.27	≤-27	PASS
11AC20SISO	Ant1	High	5825	5850~5855	-40.67	≤18.50	PASS
11AC20SISO	Ant1	High	5825	5855~5875	-41	≤10.36	PASS
11AC20SISO	Ant1	High	5825	5875~5925	-44.72	≤-25.11	PASS
11AC20SISO	Ant1	High	5825	5925~5935	-43.98	≤-27	PASS
11AC40SISO	Ant1	Low	5755	5720~5725	-36.68	≤15.74	PASS
11AC40SISO	Ant1	Low	5755	5700~5720	-34.34	≤14.94	PASS
11AC40SISO	Ant1	Low	5755	5650~5700	-45.98	≤-26.90	PASS
11AC40SISO	Ant1	Low	5755	5780~5650	-45.45	≤-27	PASS
11AC40SISO	Ant1	High	5795	5850~5855	-44.85	≤15.66	PASS
11AC40SISO	Ant1	High	5795	5855~5875	-43.62	≤11.03	PASS
11AC40SISO	Ant1	High	5795	5875~5925	-45.96	≤-26.83	PASS

Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

11AC40SISO	Ant1	High	5795	5925~5935	-45.65	≤-27	PASS
11AC80SISO	Ant1	Low	5775	5720~5725	-29.84	≤15.65	PASS
11AC80SISO	Ant1	Low	5775	5700~5720	-32.95	≤10.22	PASS
11AC80SISO	Ant1	Low	5775	5650~5700	-42.18	≤-26.91	PASS
11AC80SISO	Ant1	Low	5775	5800~5650	-41.21	≤-27	PASS
11AC80SISO	Ant1	High	5775	5850~5855	-35.65	≤17.10	PASS
11AC80SISO	Ant1	High	5775	5855~5875	-37.94	≤10.45	PASS
11AC80SISO	Ant1	High	5775	5875~5925	-42.98	≤-26.19	PASS
11AC80SISO	Ant1	High	5775	5925~5935	-42.84	≤-27	PASS
11AX20SISO	Ant1	Low	5745	5720~5725	-35.17	≤17.39	PASS
11AX20SISO	Ant1	Low	5745	5700~5720	-41.22	≤10.64	PASS
11AX20SISO	Ant1	Low	5745	5650~5700	-45.2	≤-26.36	PASS
11AX20SISO	Ant1	Low	5745	5760~5650	-45.46	≤-27	PASS
11AX20SISO	Ant1	High	5825	5850~5855	-43.27	≤16.34	PASS
11AX20SISO	Ant1	High	5825	5855~5875	-43.53	≤10.44	PASS
11AX20SISO	Ant1	High	5825	5875~5925	-45.9	≤-26.91	PASS
11AX20SISO	Ant1	High	5825	5925~5935	-45.65	≤-27	PASS
11AX40SISO	Ant1	Low	5755	5720~5725	-36.44	≤15.74	PASS
11AX40SISO	Ant1	Low	5755	5700~5720	-37.2	≤11.50	PASS
11AX40SISO	Ant1	Low	5755	5650~5700	-45.34	≤-26.50	PASS
11AX40SISO	Ant1	Low	5755	5780~5650	-45.38	≤-27	PASS
11AX40SISO	Ant1	High	5795	5850~5855	-44.16	≤15.66	PASS
11AX40SISO	Ant1	High	5795	5855~5875	-45.29	≤10.11	PASS
11AX40SISO	Ant1	High	5795	5875~5925	-44.82	≤-25.49	PASS
11AX40SISO	Ant1	High	5795	5925~5935	-44.48	≤-27	PASS
11AX80SISO	Ant1	Low	5775	5720~5725	-26.17	≤15.65	PASS
11AX80SISO	Ant1	Low	5775	5700~5720	-26.22	≤11.57	PASS
11AX80SISO	Ant1	Low	5775	5650~5700	-39.29	≤-26.57	PASS
11AX80SISO	Ant1	Low	5775	5800~5650	-39.56	≤-27	PASS
11AX80SISO	Ant1	High	5775	5850~5855	-28.96	≤17.10	PASS
11AX80SISO	Ant1	High	5775	5855~5875	-27.26	≤10.66	PASS
11AX80SISO	Ant1	High	5775	5875~5925	-35.46	≤-19.07	PASS
11AX80SISO	Ant1	High	5775	5925~5935	-37.43	≤-27	PASS

Note: 1.The Antenna gain and cable loss are compensated in the graph.

Test Graphs B1/2/3

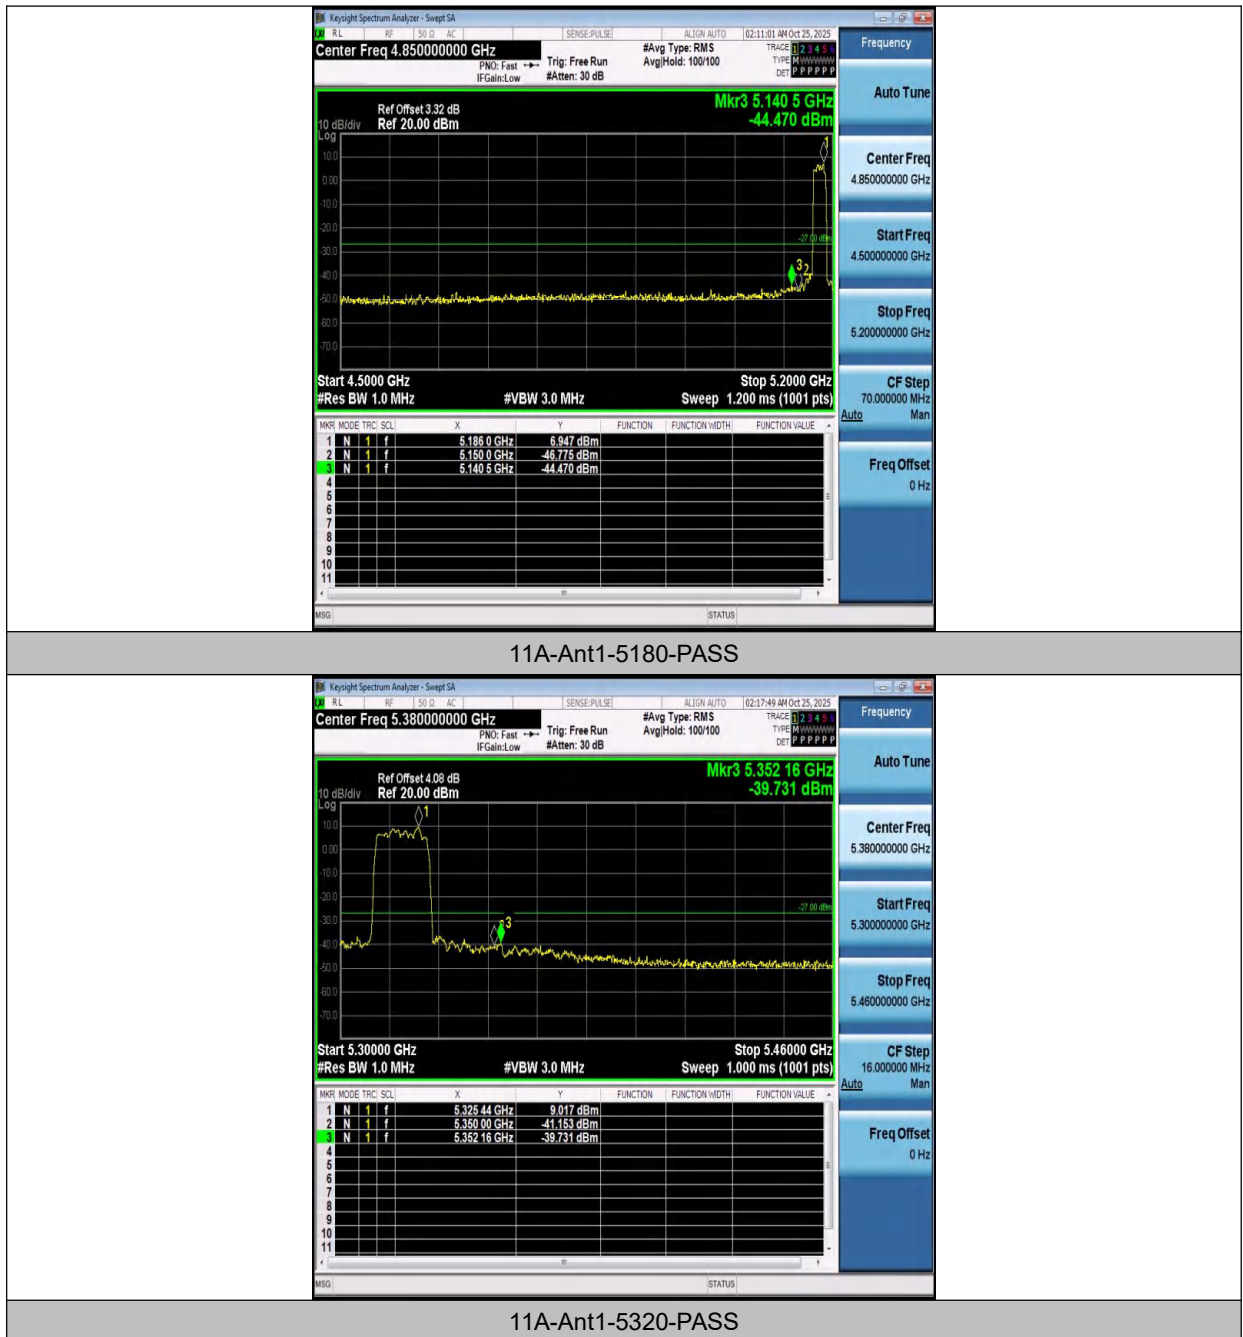



Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com




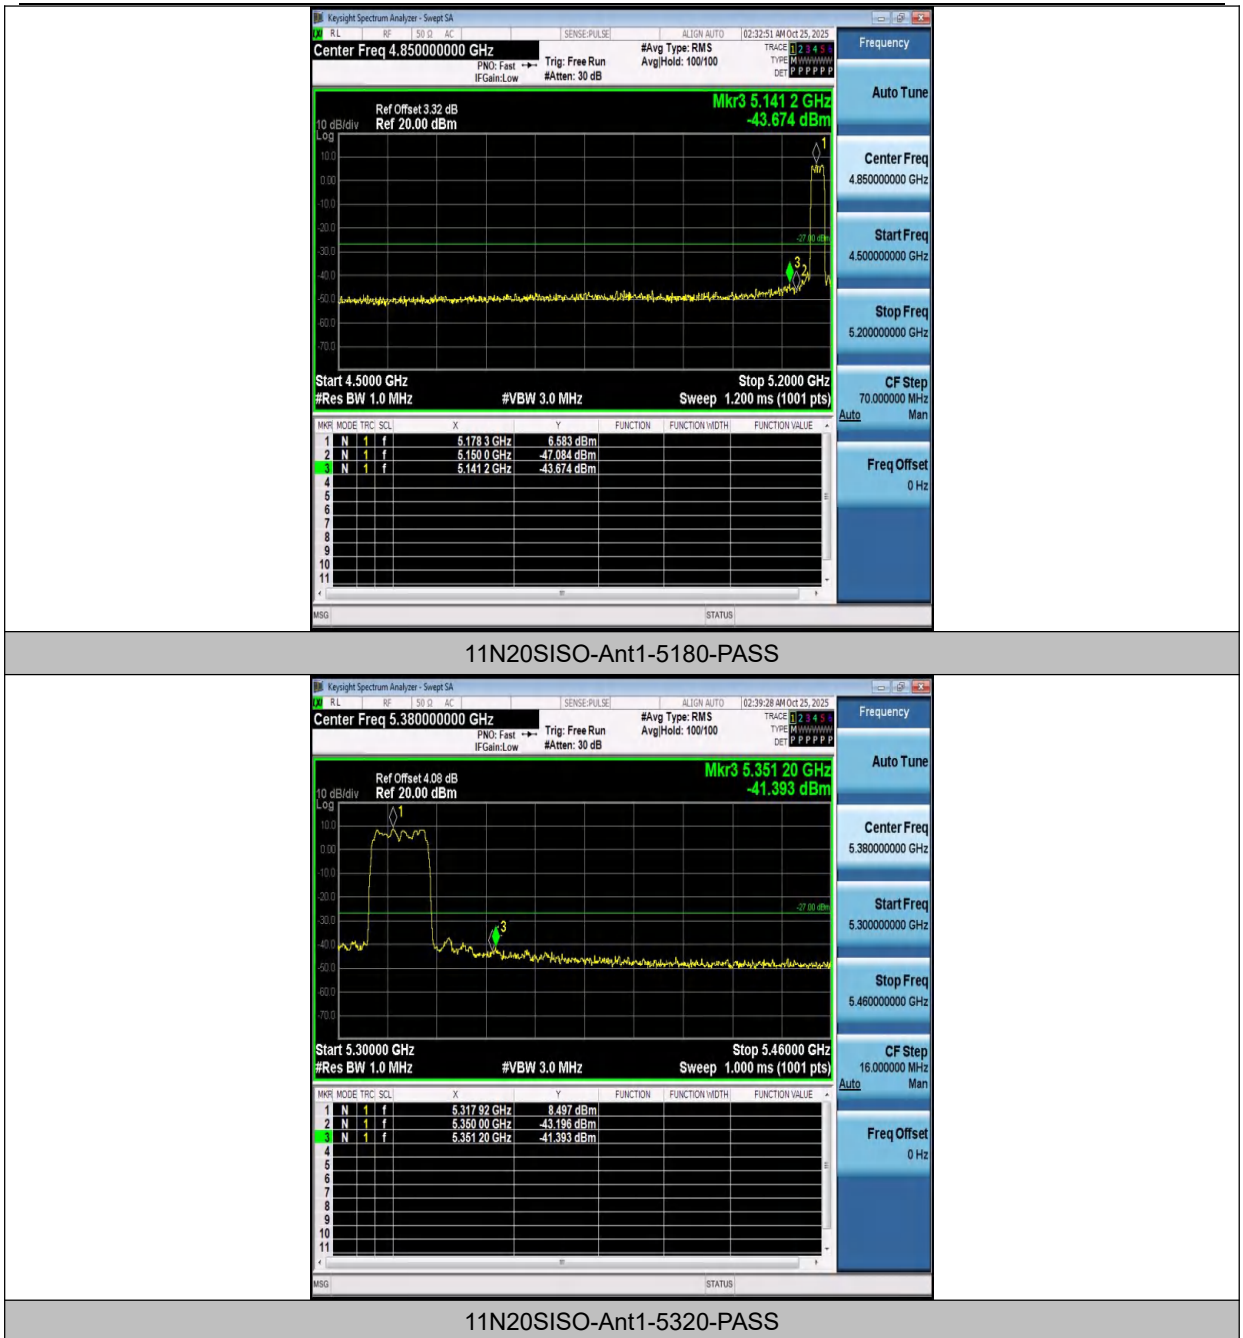


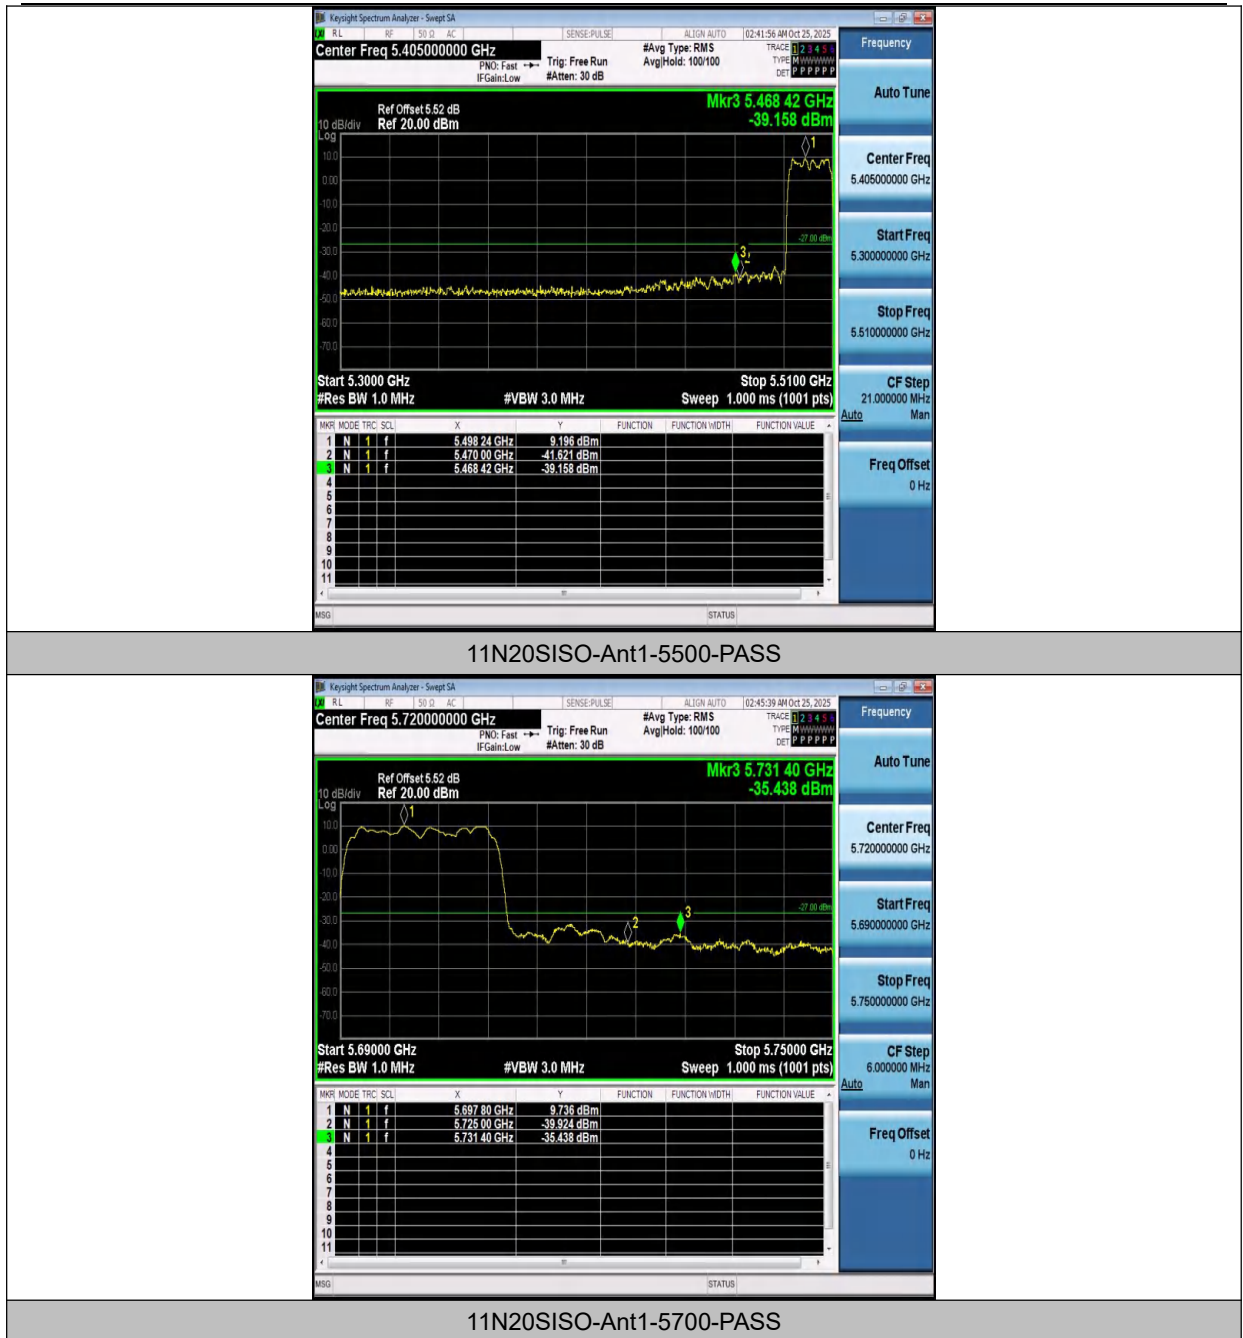


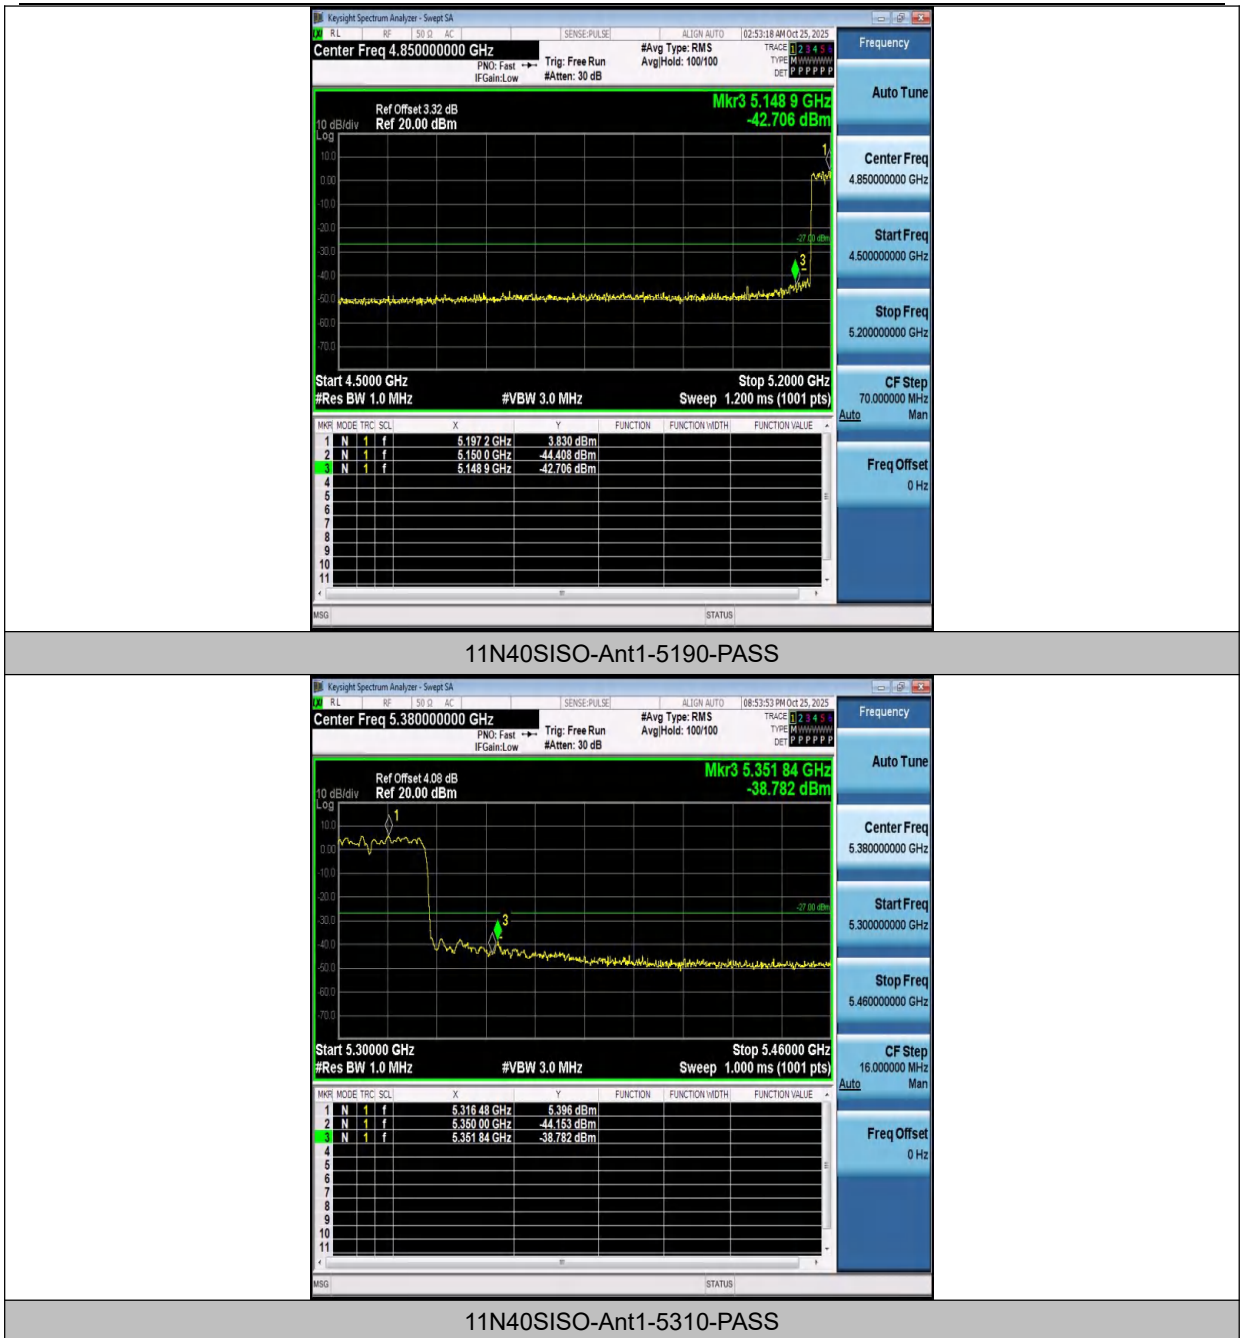





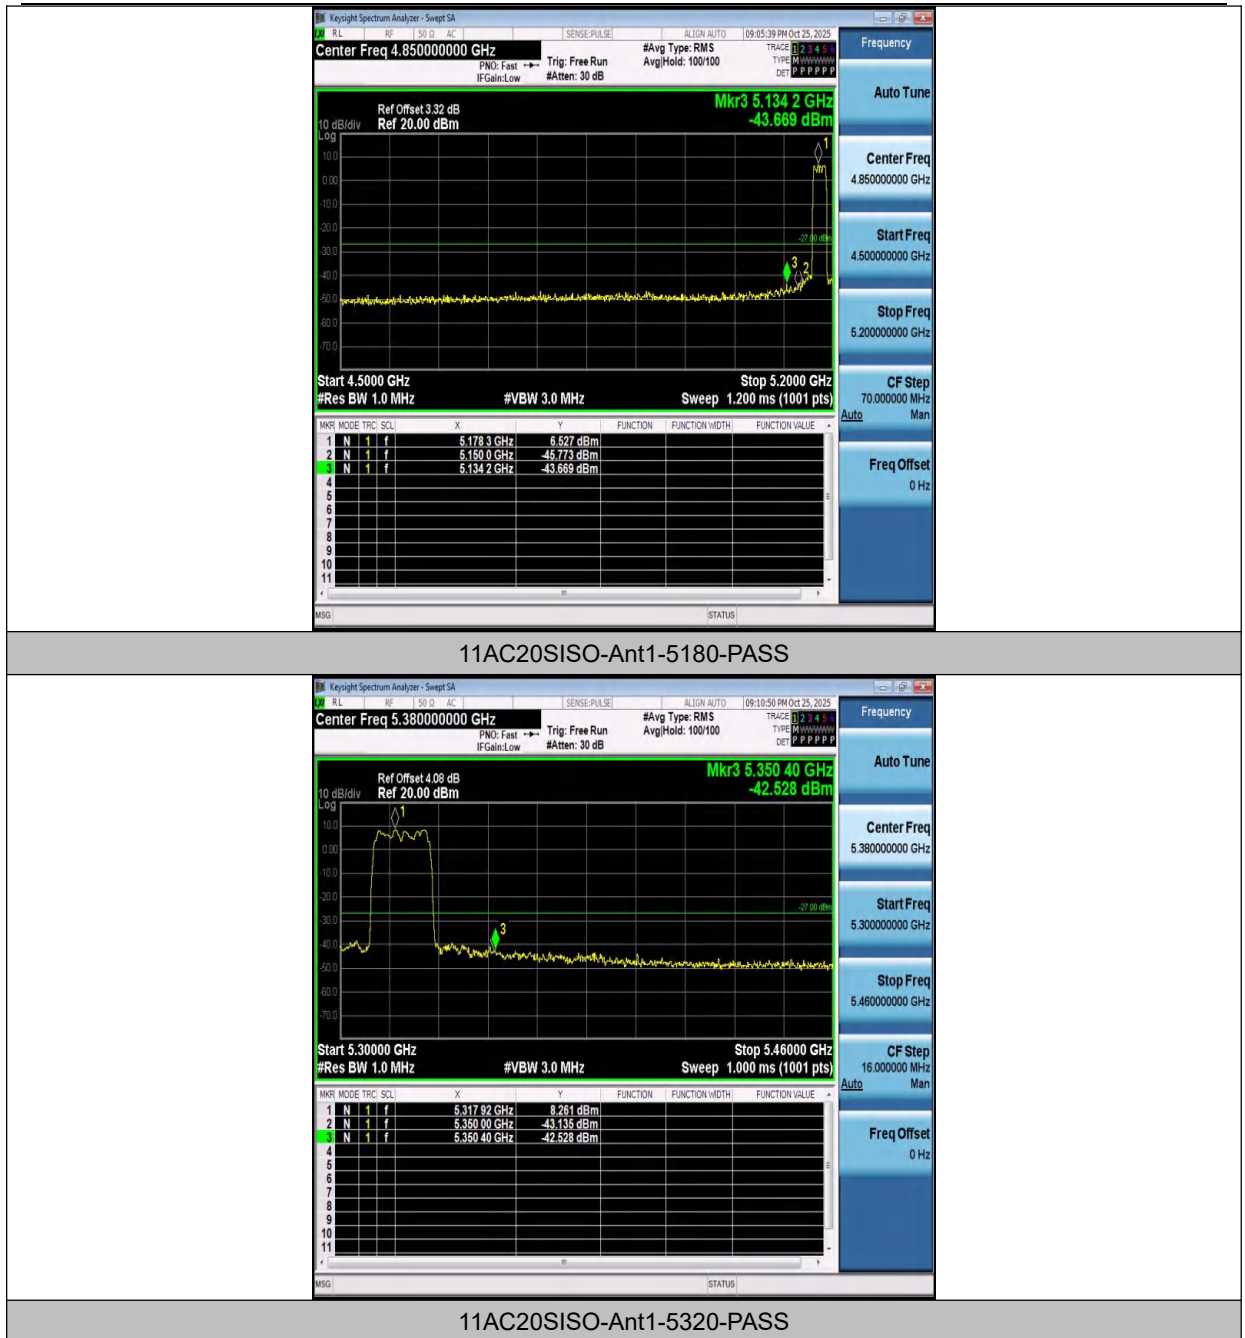

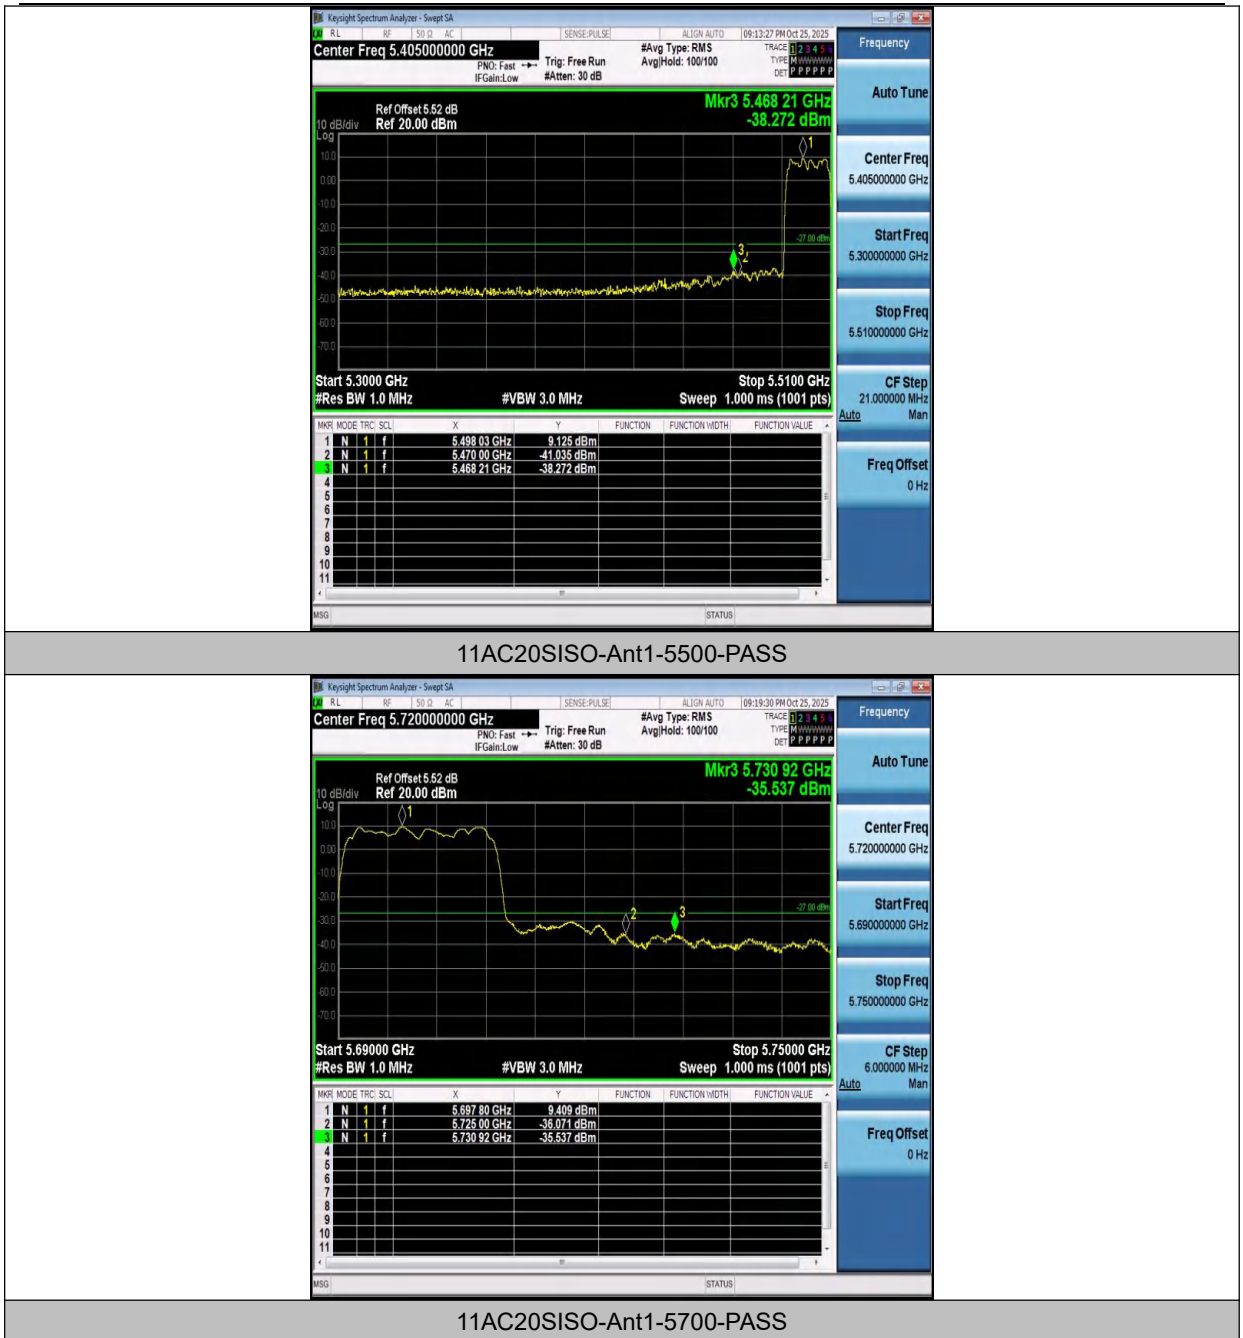


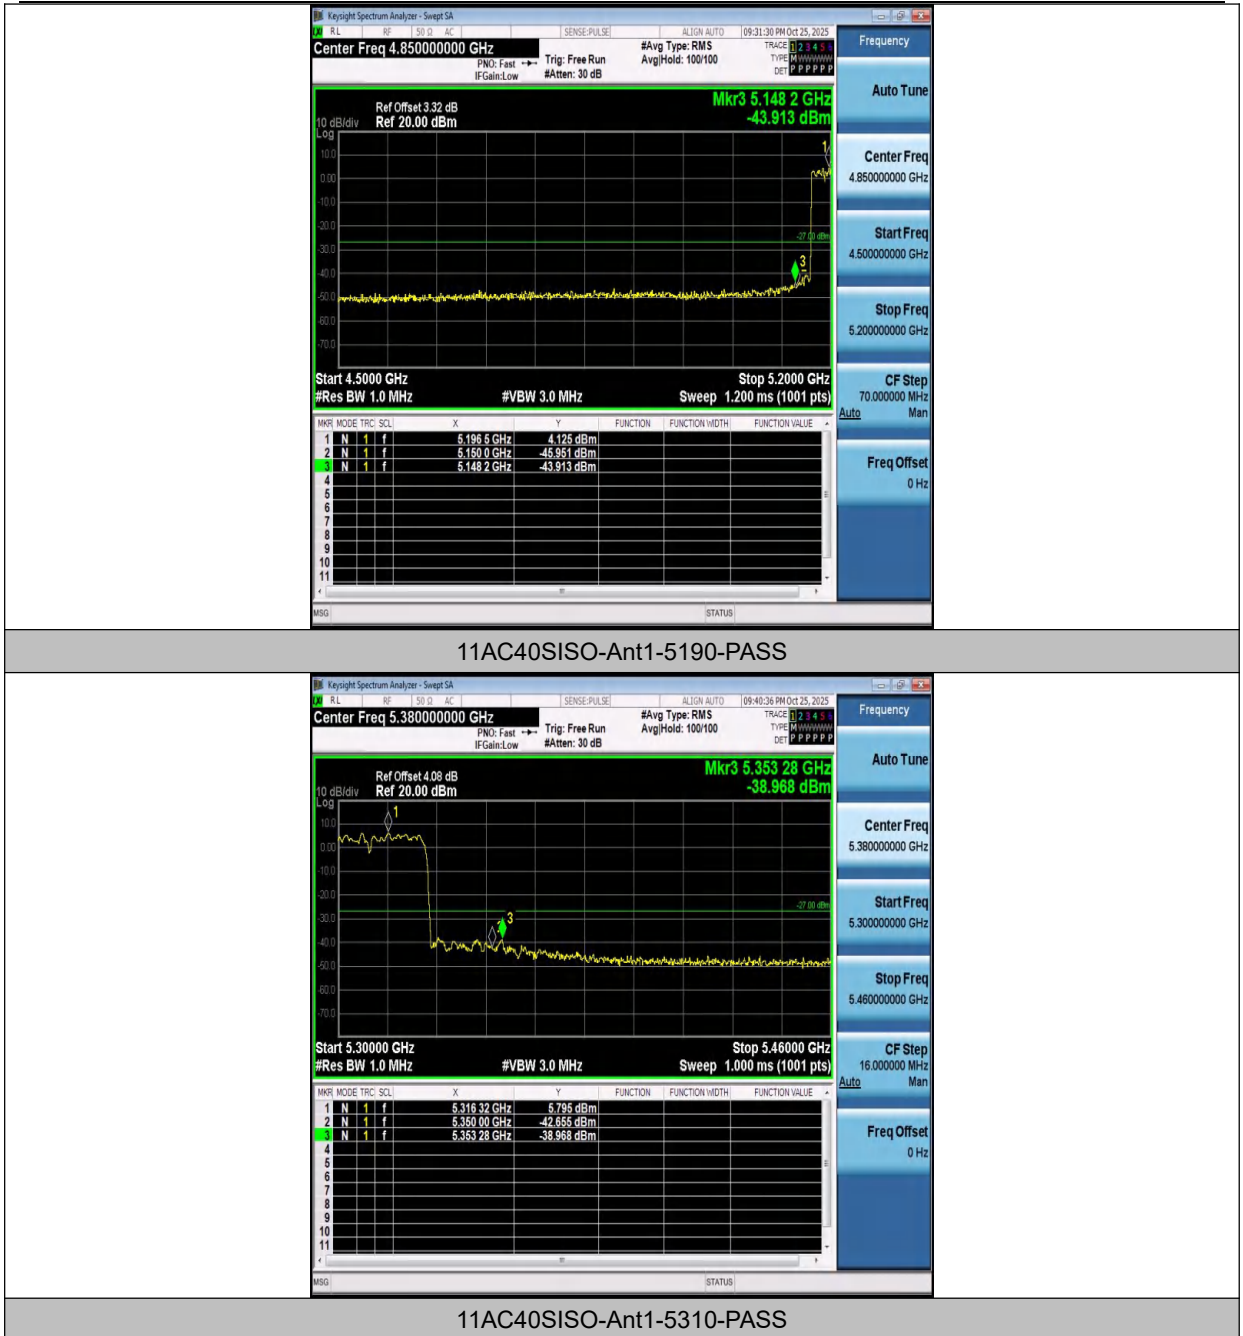


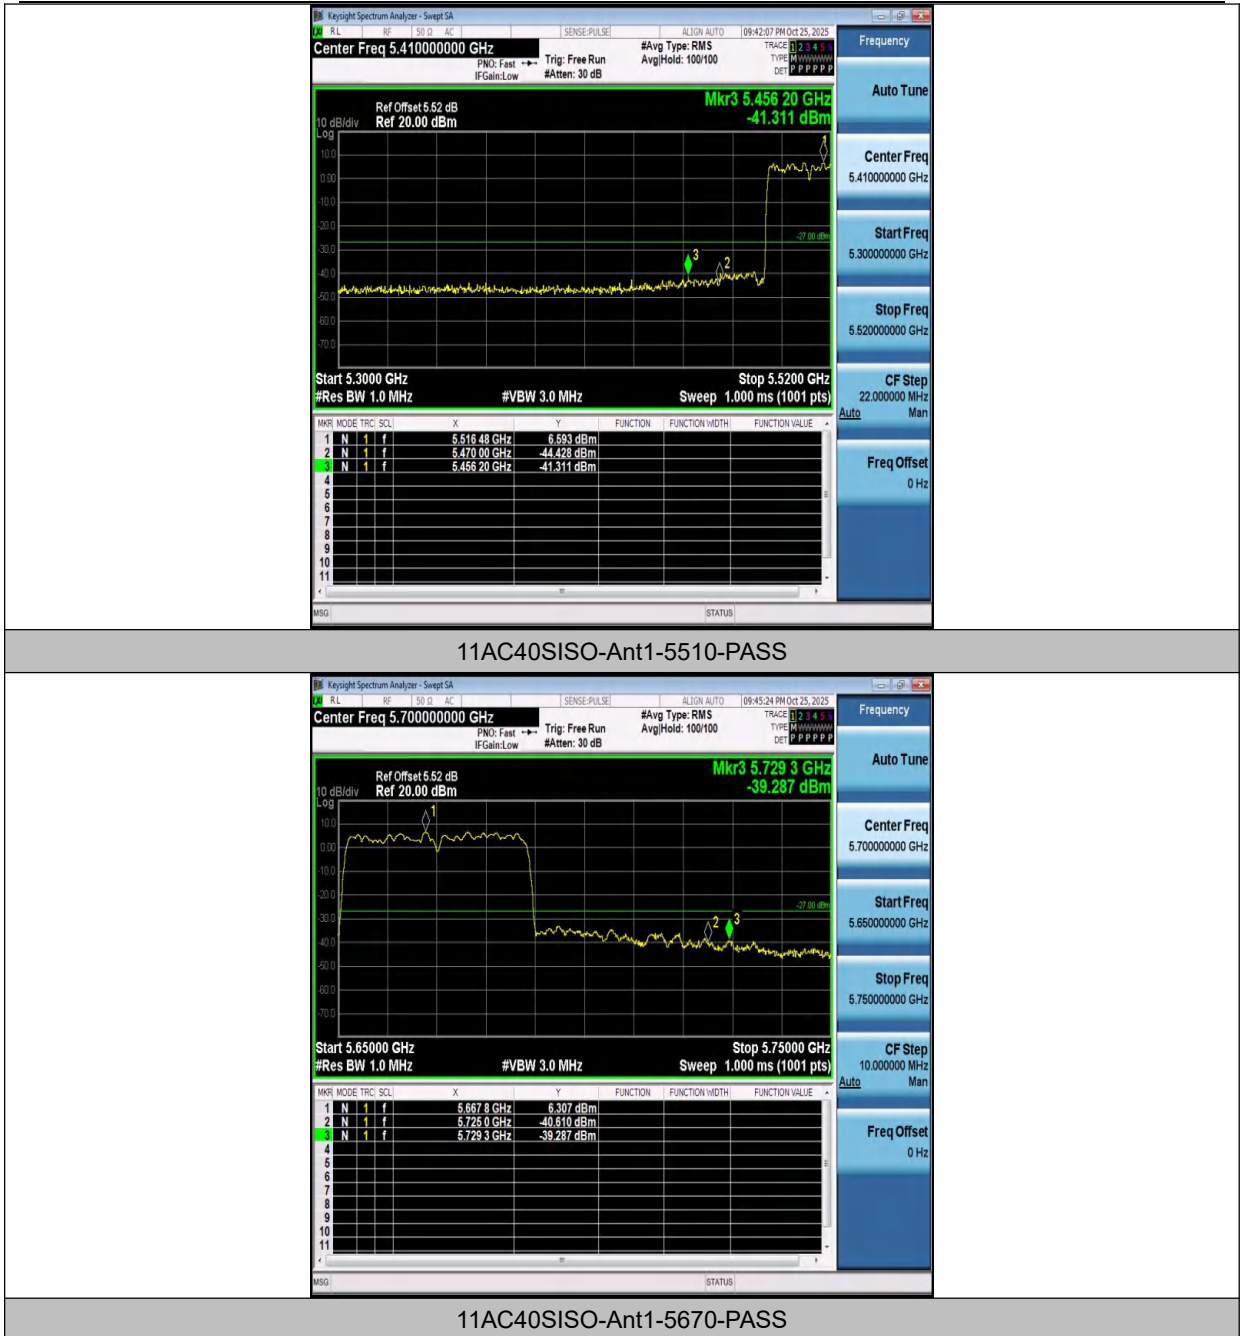


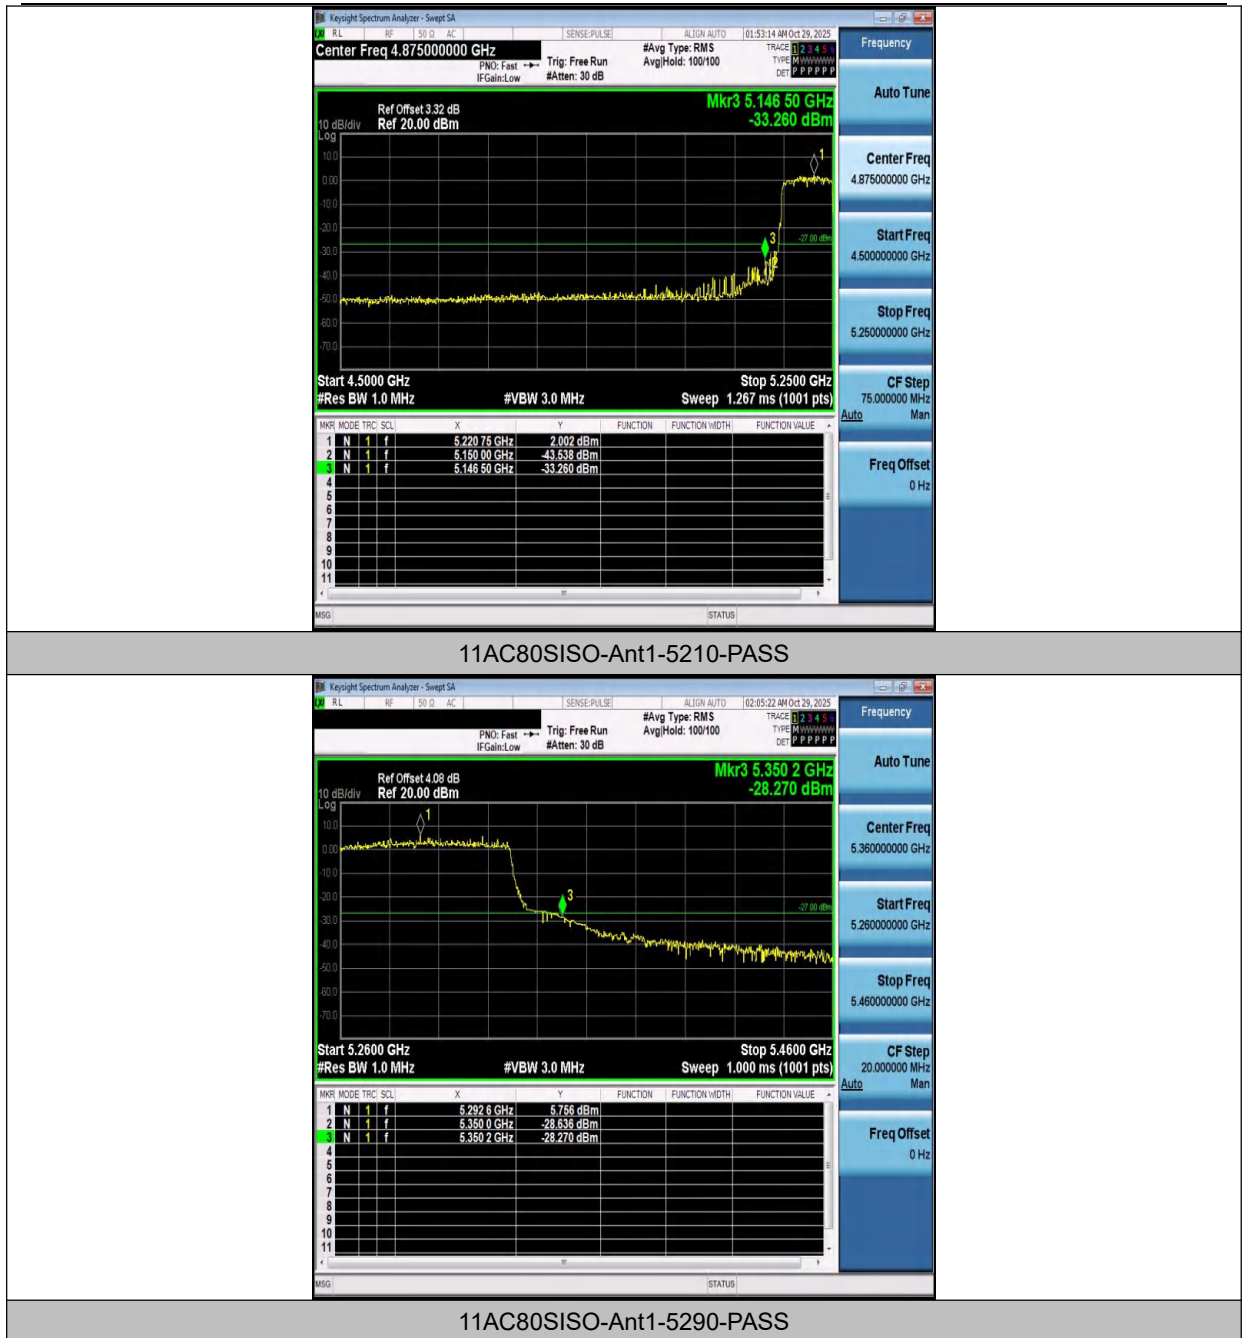



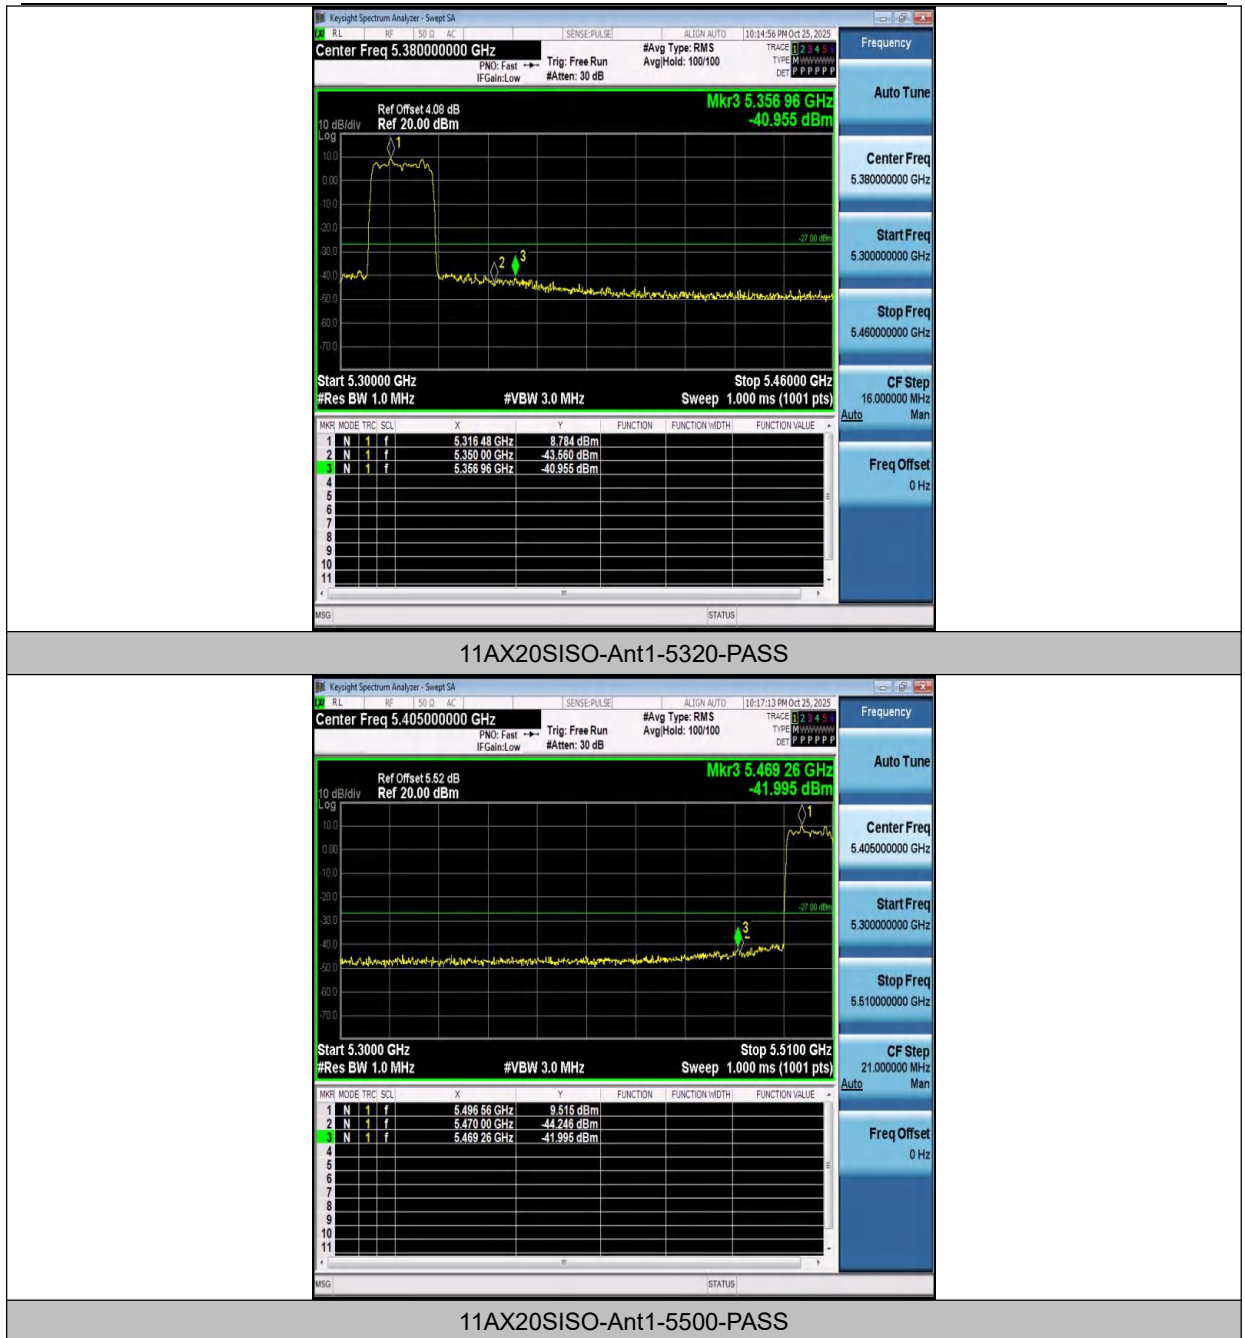

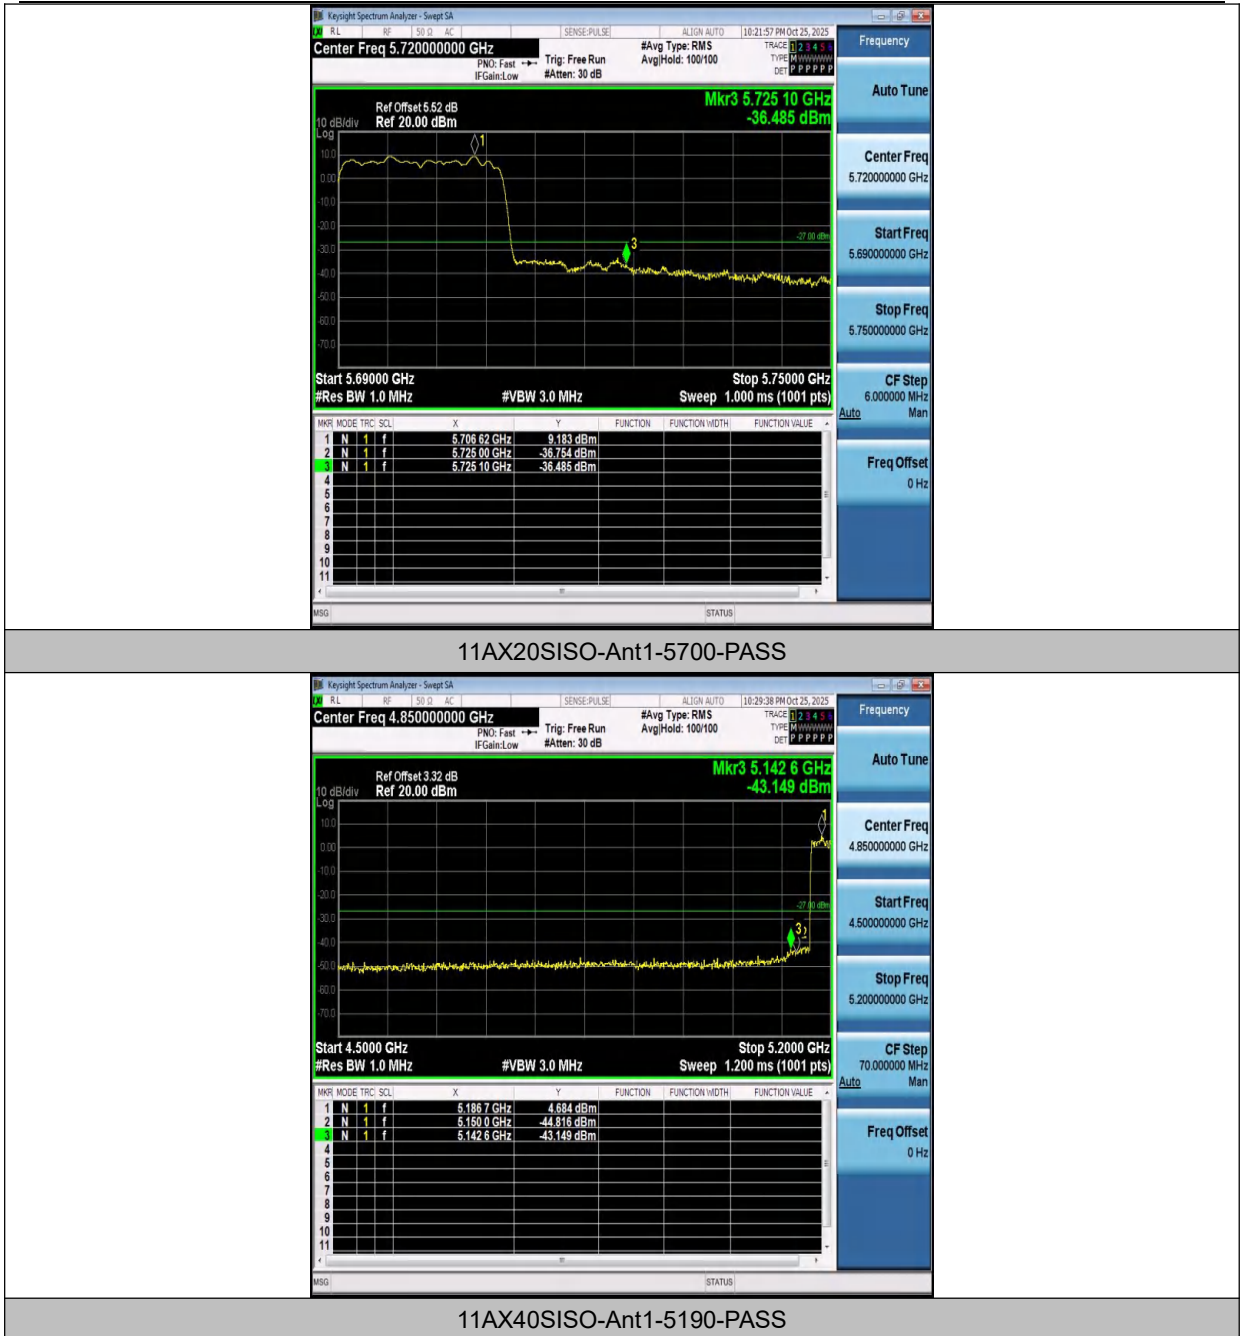


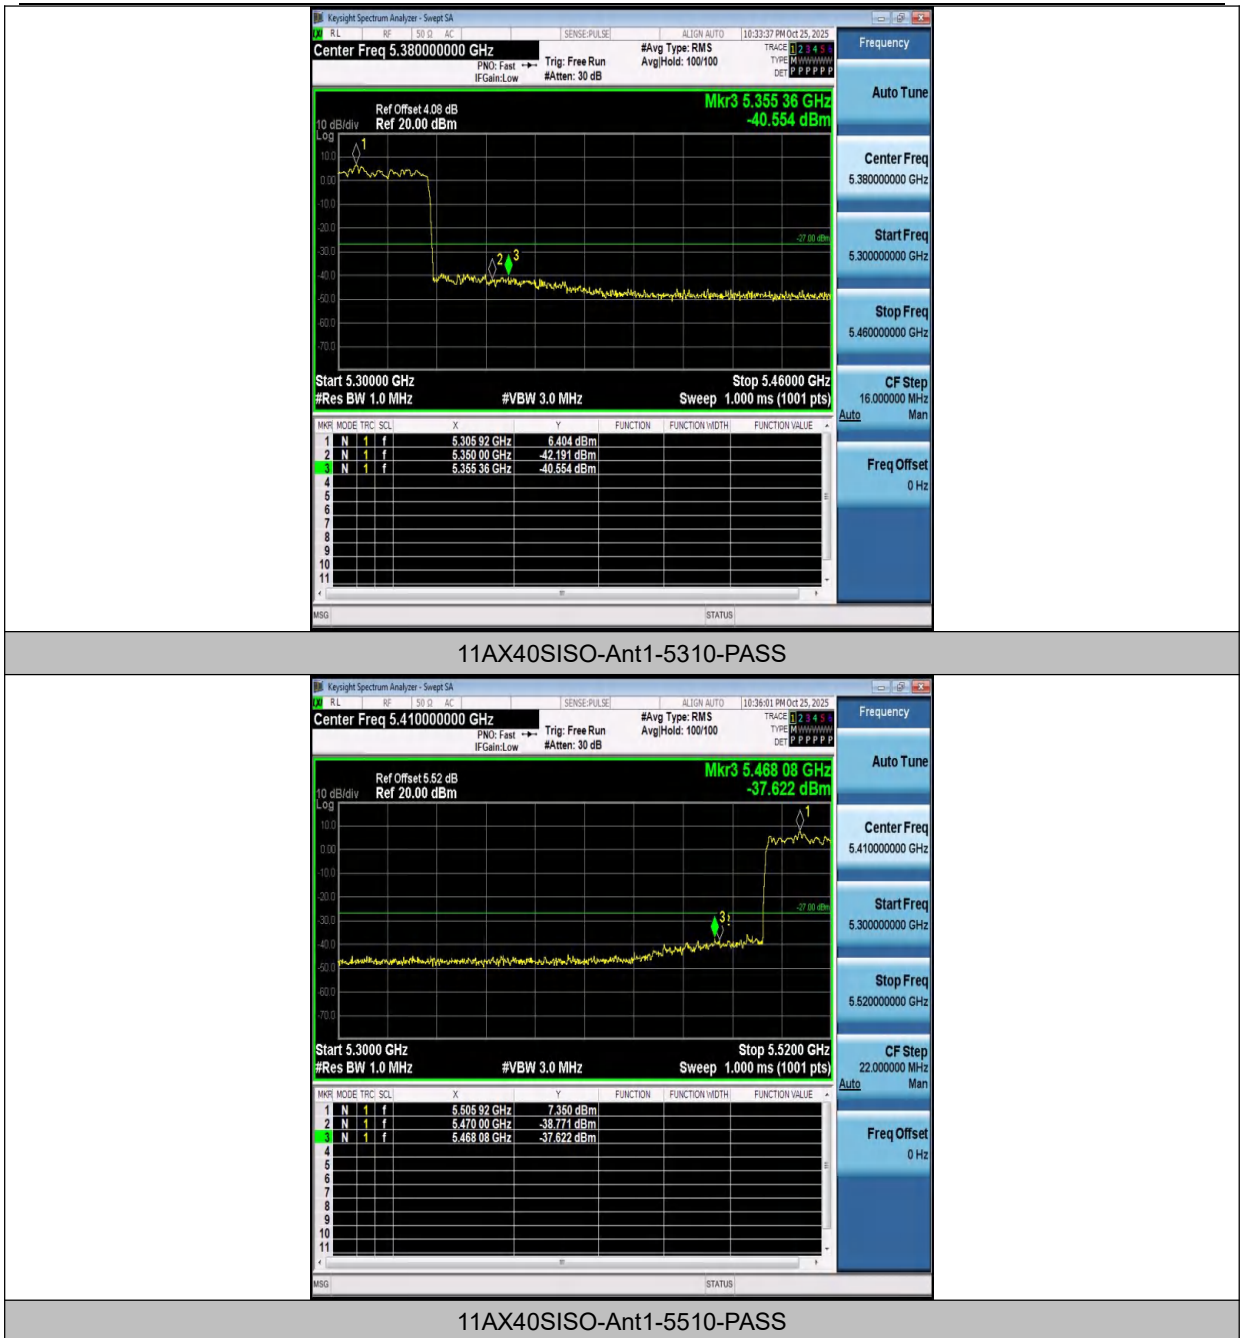

Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

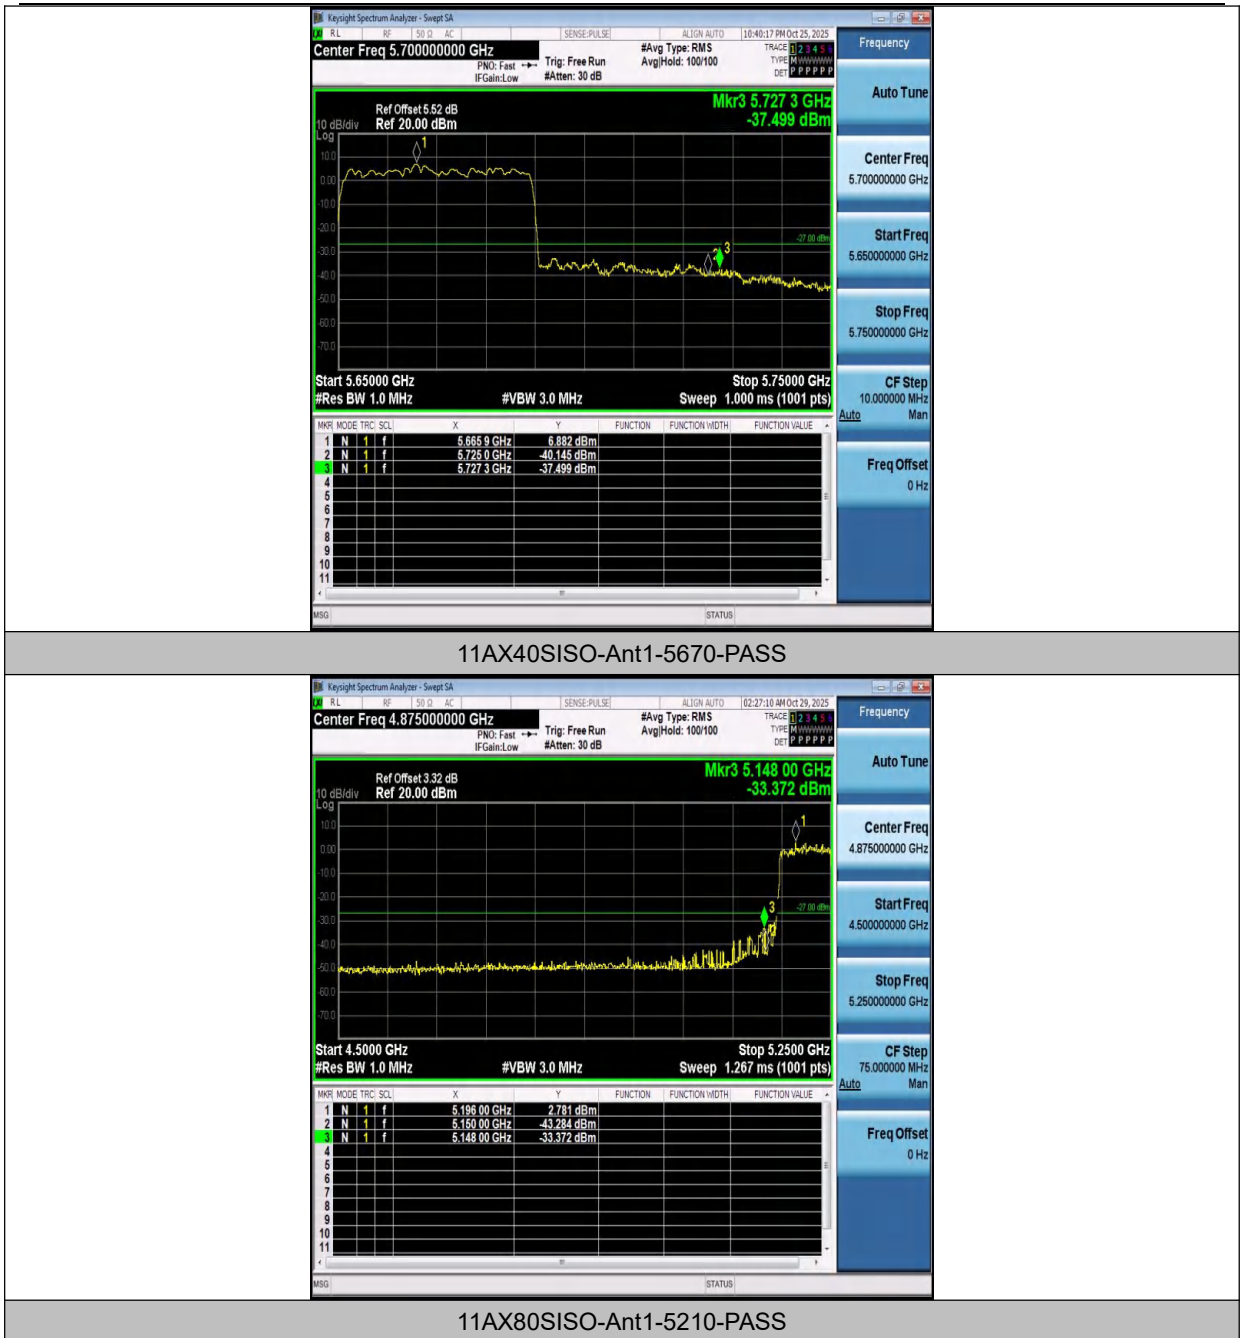



Test Graphs B4

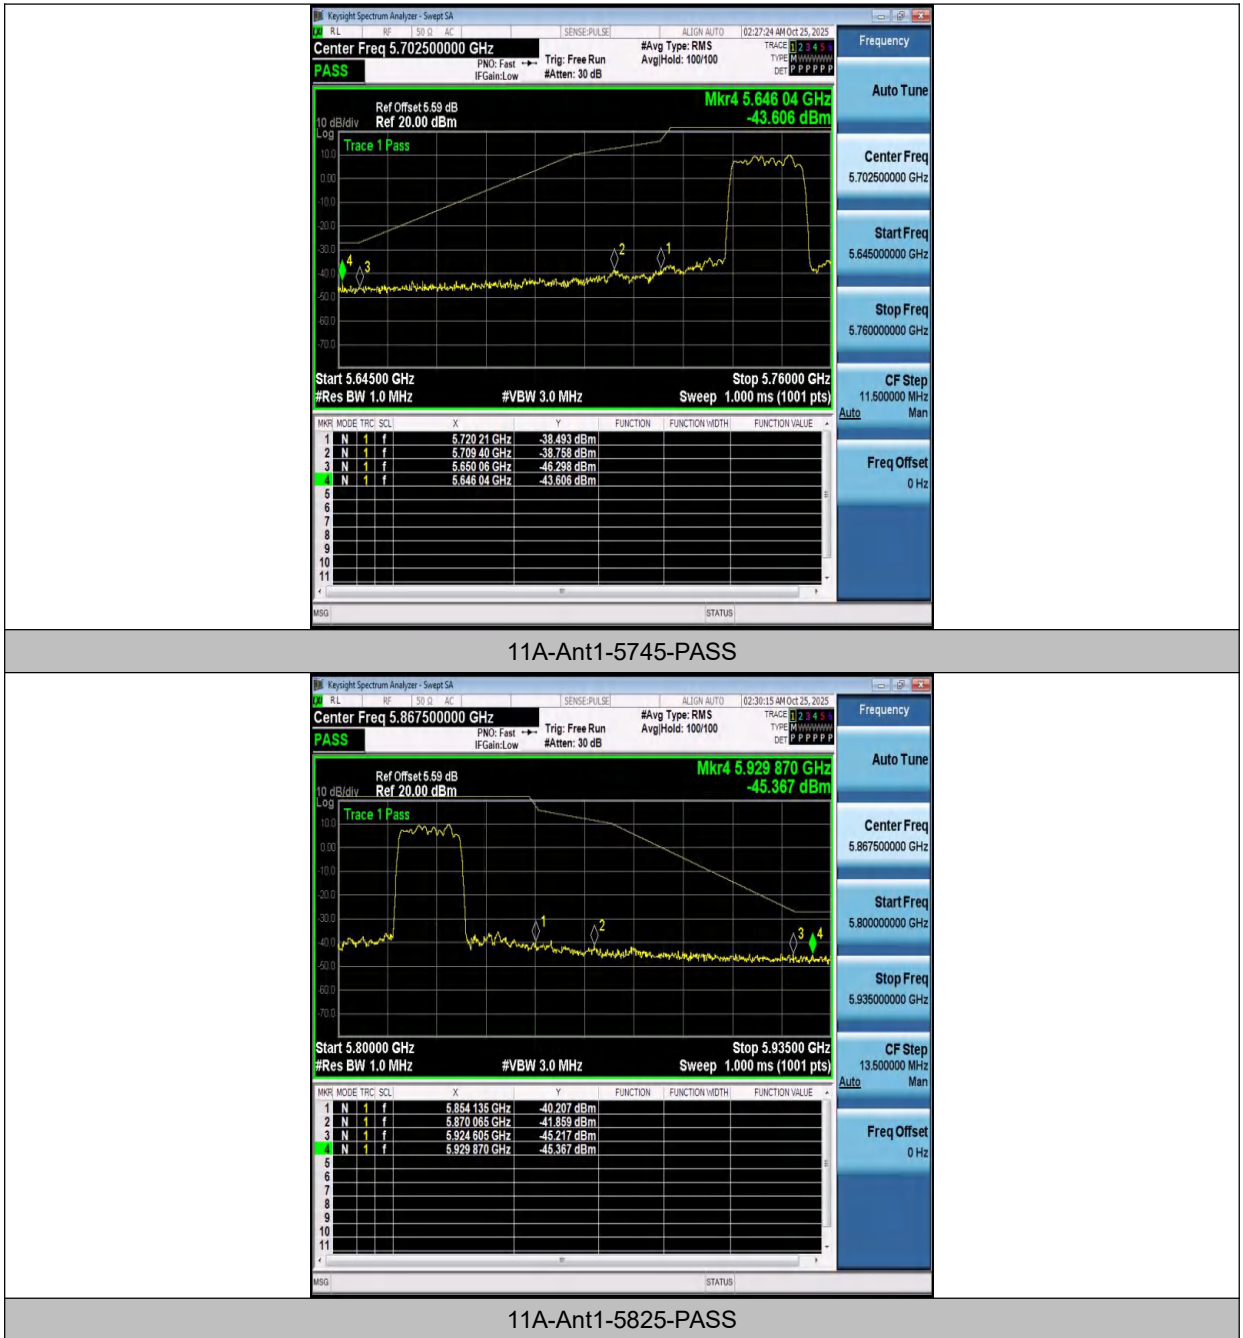


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com






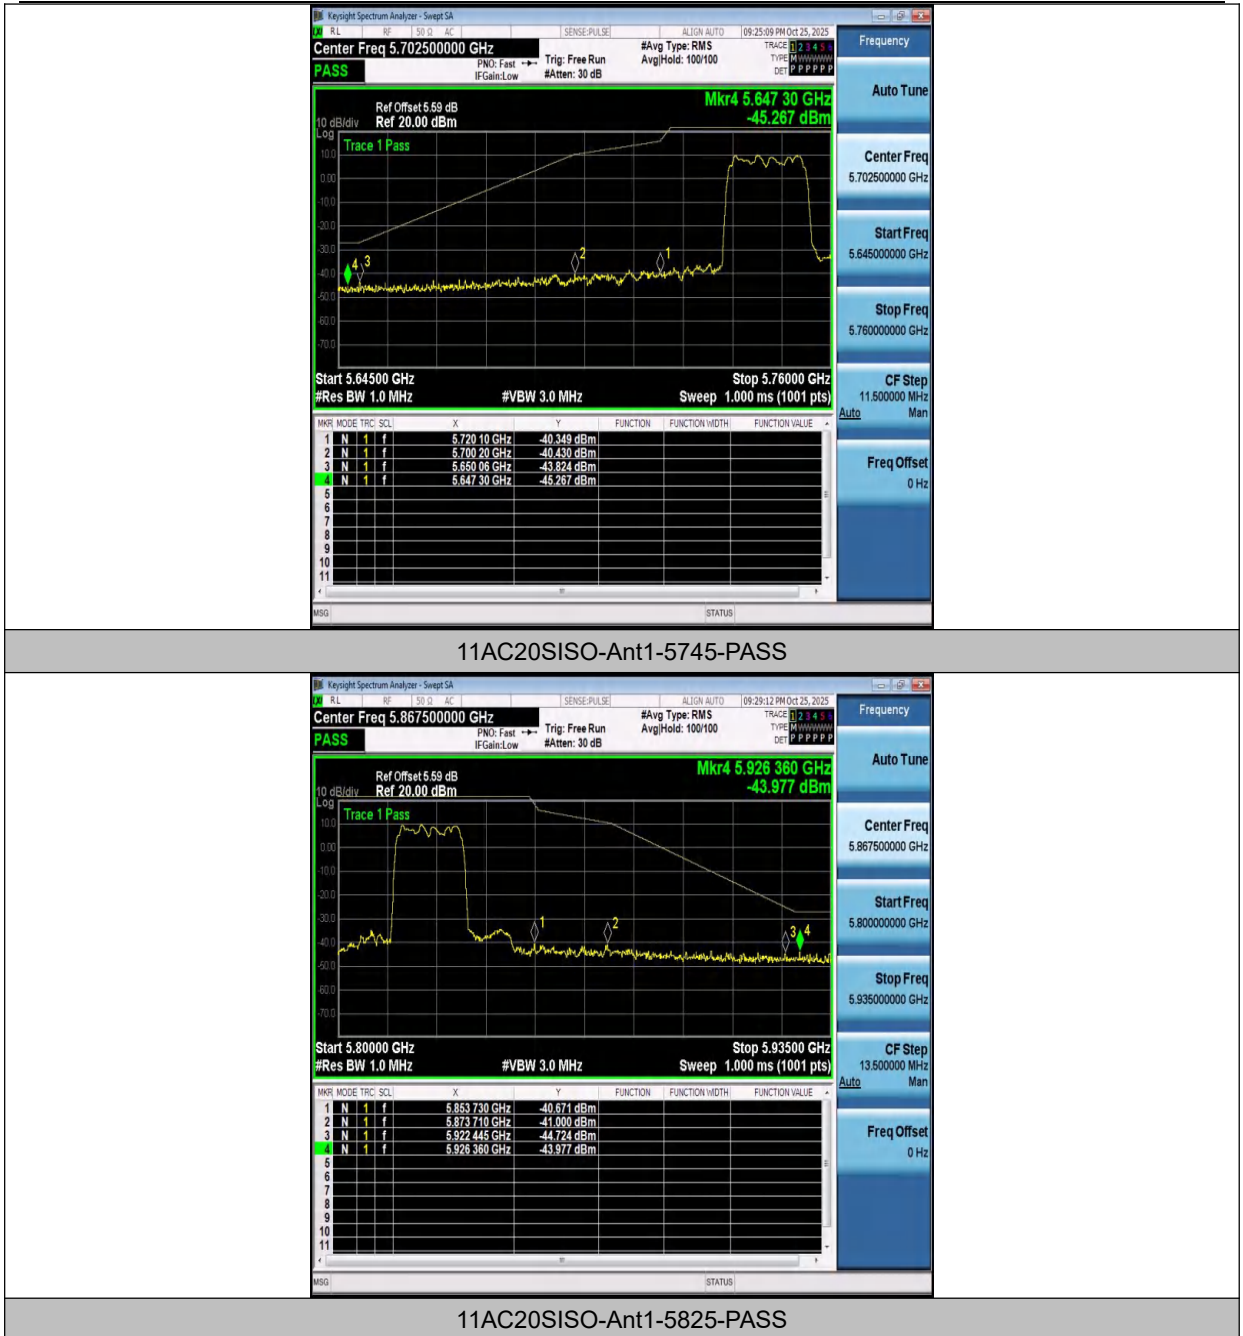





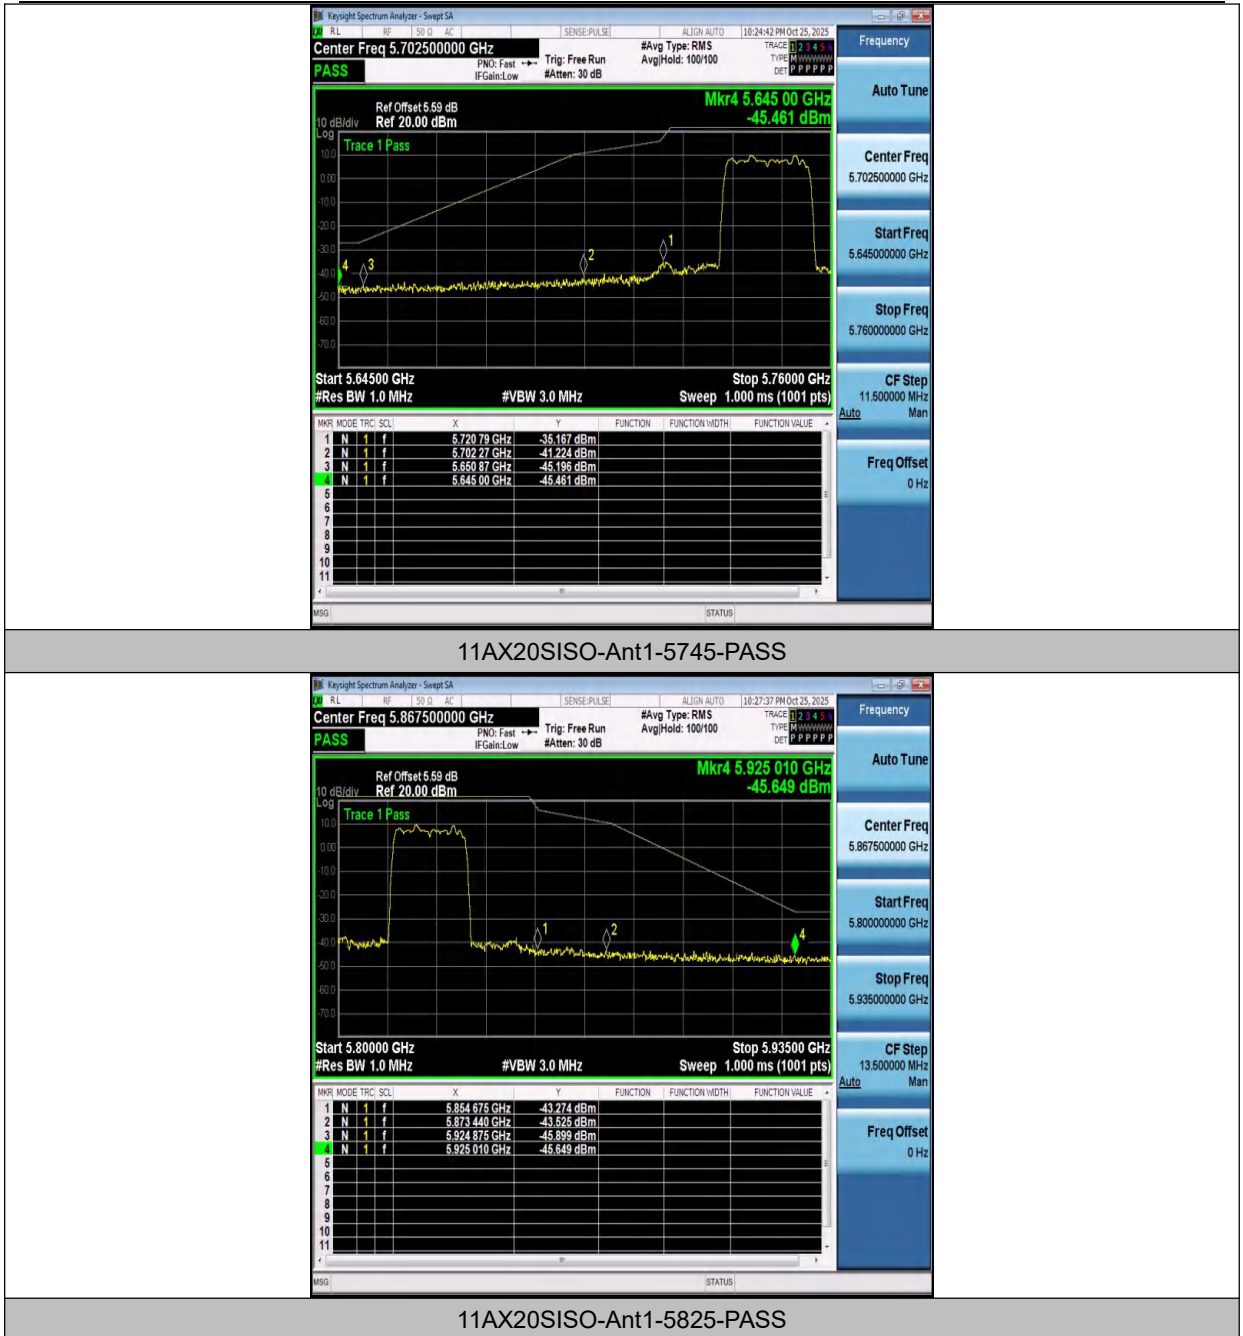



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com




Appendix F: DFS Detection Thresholds

Test Result

TestMode	Frequency[MHz]	Radar Type	Result[dbm]	Limit[dbm]	Verdict
11AX80SISO	5290	Type0	-63.14	-62.00	PASS
	5530	Type0	-63.03	-62.00	PASS

Test Graphs

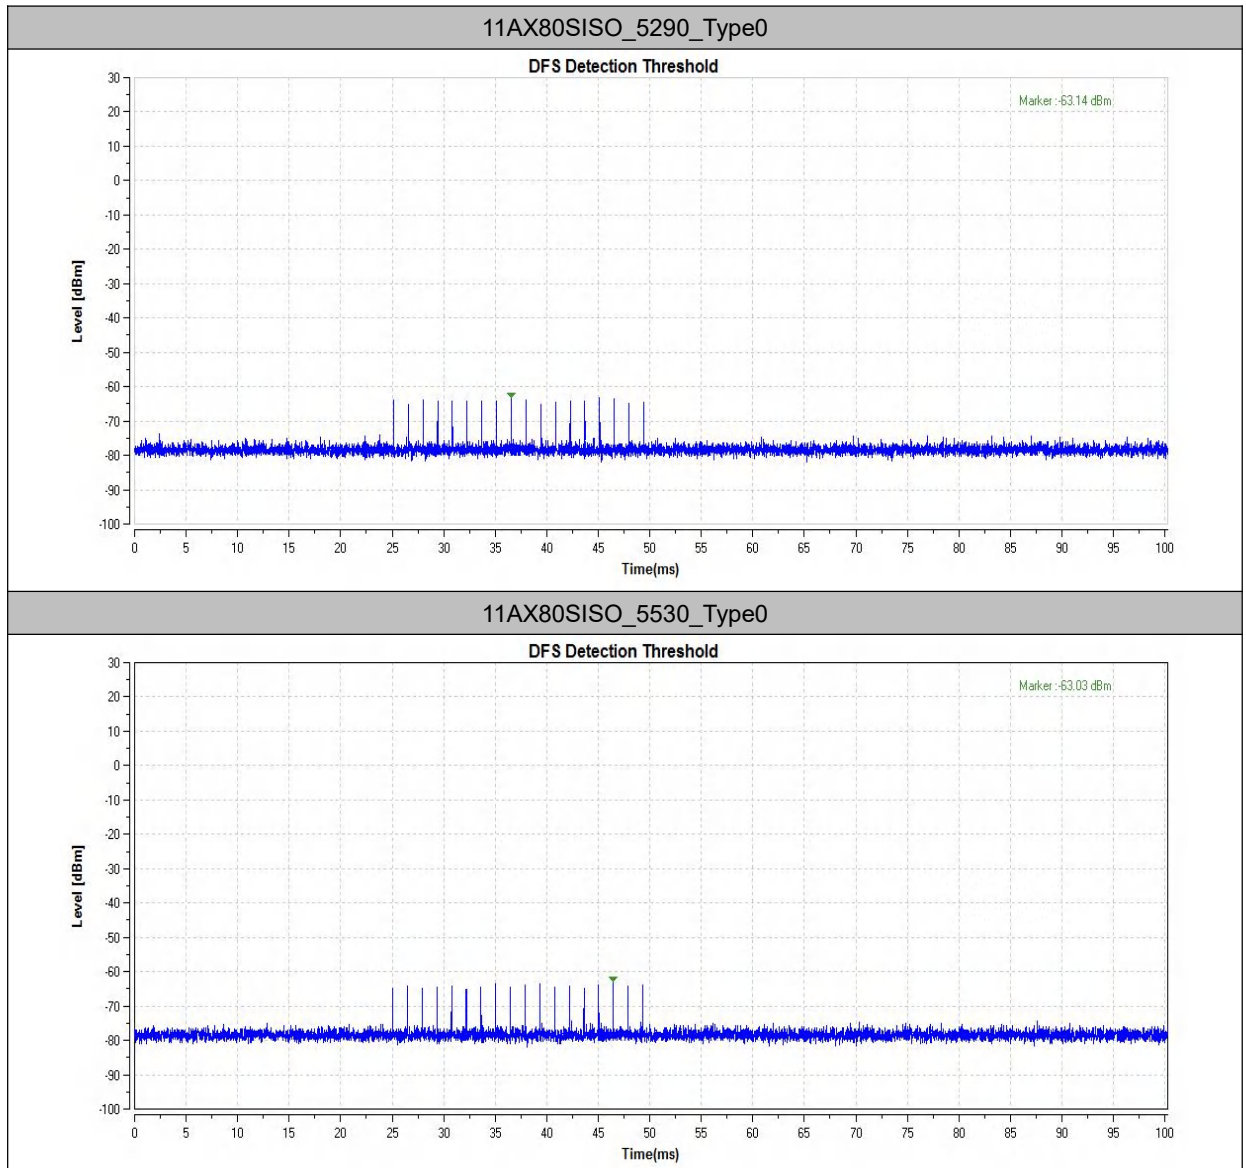

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Appendix G: Channel Move Time and Channel Closing

Transmission Time

Test Result

TestMode	Frequency[MHz]	CCT[ms]	Limit[ms]	CMT[ms]	Limit[ms]	Verdict
11AX80SISO	5290	200+9.1	200+60	428.2	10000	PASS
11AX80SISO	5530	200+6.5	200+60	228.5	10000	PASS

Test Graphs

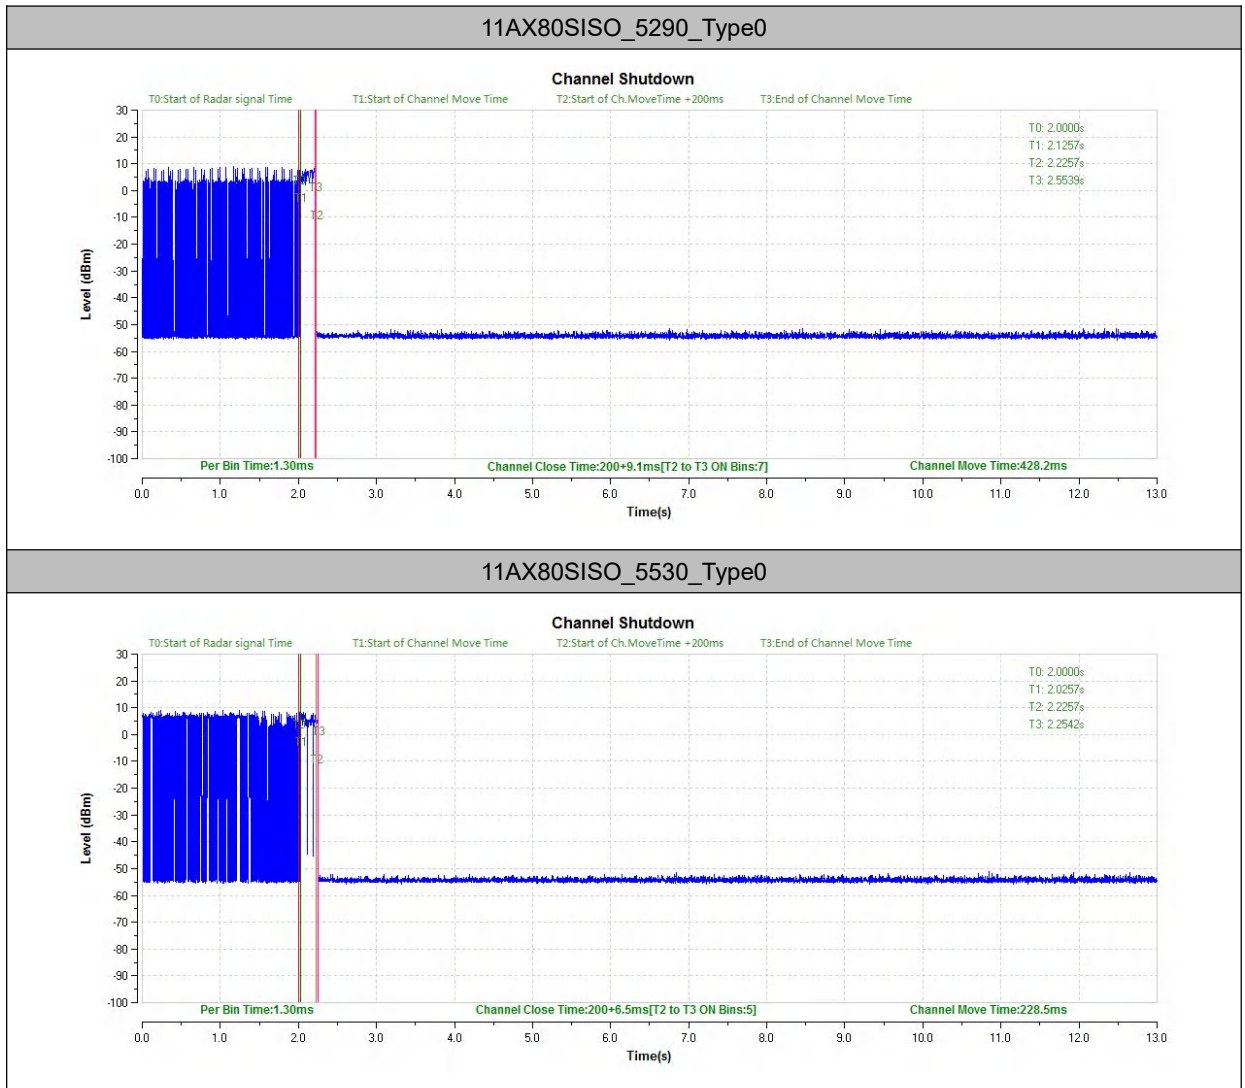

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix H: Non-Occupancy Period

Test Result

TestMode	Frequency[MHz]	Result	Limit[s]	Verdict
11AX80SISO	5290	see test graph	≥1800	PASS
11AX80SISO	5530	see test graph	≥1800	PASS

Test Graphs

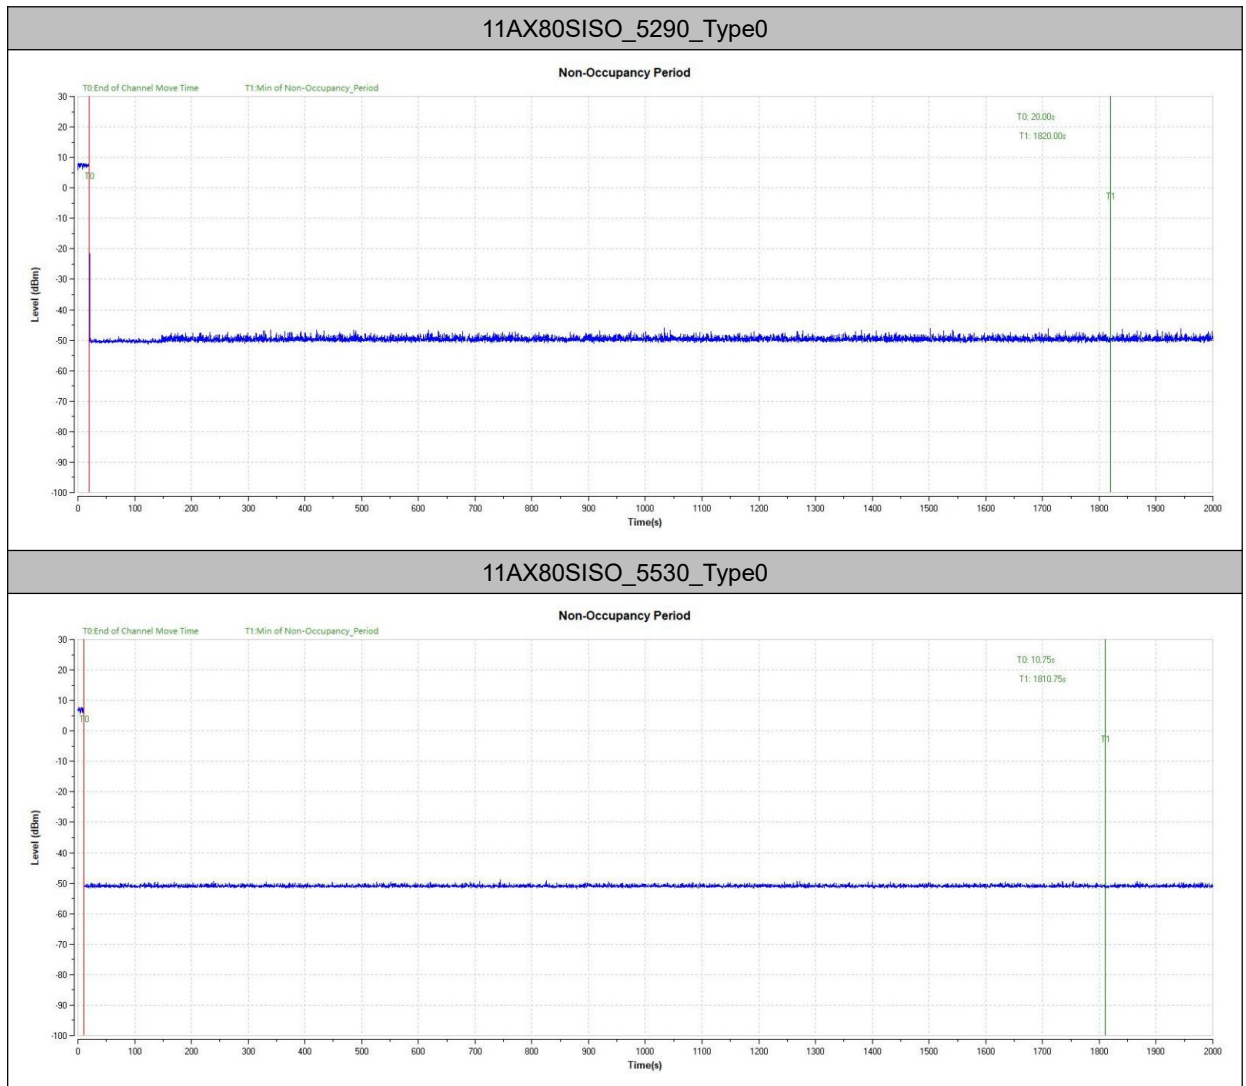

---END---