

Appendix Test Data

Report No.:	1813C50436212503-01	Test Sample No.:	1-2-2
Start Test Date:	2025-10-14	Finish Test Date:	2025-10-21
Test Engineer:	<i>dylan. Ma</i>	Auditor:	<i>Justin Feng</i>
Temperature:	22.0°C	Relative Humidity:	53%
Pressure:	101kPa		



Appendix A1: 26dB Bandwidth

Test Result

Test Mode	Antenna	Frequency[MHz]	26db EBW [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5180	22.04	5168.72	5190.76	---	---
11A	Ant1	5200	24.32	5187.36	5211.68	---	---
11A	Ant1	5240	23.64	5228.28	5251.92	---	---
11A	Ant1	5260	22.72	5248.44	5271.16	---	---
11A	Ant1	5280	24.08	5267.60	5291.68	---	---
11A	Ant1	5320	23.20	5308.32	5331.52	---	---
11A	Ant1	5500	25.44	5487.32	5512.76	---	---
11A	Ant1	5580	24.40	5568.08	5592.48	---	---
11A	Ant1	5700	23.76	5688.04	5711.80	---	---
11A	Ant1	5745	23.52	5733.32	5756.84	---	---
11A	Ant1	5785	24.12	5773.12	5797.24	---	---
11A	Ant1	5825	24.32	5812.68	5837.00	---	---
11N20SISO	Ant1	5180	25.08	5167.16	5192.24	---	---
11N20SISO	Ant1	5200	25.80	5186.52	5212.32	---	---
11N20SISO	Ant1	5240	25.60	5227.04	5252.64	---	---
11N20SISO	Ant1	5260	24.64	5247.40	5272.04	---	---
11N20SISO	Ant1	5280	25.64	5267.12	5292.76	---	---
11N20SISO	Ant1	5320	25.32	5307.52	5332.84	---	---
11N20SISO	Ant1	5500	25.68	5487.08	5512.76	---	---
11N20SISO	Ant1	5580	23.84	5568.32	5592.16	---	---
11N20SISO	Ant1	5700	25.12	5687.40	5712.52	---	---
11N20SISO	Ant1	5745	26.48	5732.20	5758.68	---	---
11N20SISO	Ant1	5785	26.04	5771.80	5797.84	---	---
11N20SISO	Ant1	5825	25.72	5812.60	5838.32	---	---
11N40SISO	Ant1	5190	44.96	5167.44	5212.40	---	---

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

11N40SISO	Ant1	5230	45.28	5206.96	5252.24	---	---
11N40SISO	Ant1	5270	45.92	5246.72	5292.64	---	---
11N40SISO	Ant1	5310	45.76	5286.88	5332.64	---	---
11N40SISO	Ant1	5510	44.64	5488.64	5533.28	---	---
11N40SISO	Ant1	5550	45.04	5528.08	5573.12	---	---
11N40SISO	Ant1	5670	44.88	5647.52	5692.40	---	---
11N40SISO	Ant1	5755	45.60	5731.56	5777.16	---	---
11N40SISO	Ant1	5795	45.84	5772.04	5817.88	---	---
11AC20SISO	Ant1	5180	25.52	5167.24	5192.76	---	---
11AC20SISO	Ant1	5200	26.28	5187.36	5213.64	---	---
11AC20SISO	Ant1	5240	23.48	5227.88	5251.36	---	---
11AC20SISO	Ant1	5260	23.80	5248.36	5272.16	---	---
11AC20SISO	Ant1	5280	25.00	5267.00	5292.00	---	---
11AC20SISO	Ant1	5320	24.32	5307.88	5332.20	---	---
11AC20SISO	Ant1	5500	26.12	5487.12	5513.24	---	---
11AC20SISO	Ant1	5580	24.68	5567.40	5592.08	---	---
11AC20SISO	Ant1	5700	25.36	5687.64	5713.00	---	---
11AC20SISO	Ant1	5745	25.16	5732.68	5757.84	---	---
11AC20SISO	Ant1	5785	25.12	5772.56	5797.68	---	---
11AC20SISO	Ant1	5825	25.76	5811.88	5837.64	---	---
11AC40SISO	Ant1	5190	44.56	5167.60	5212.16	---	---
11AC40SISO	Ant1	5230	43.76	5208.40	5252.16	---	---
11AC40SISO	Ant1	5270	43.68	5248.08	5291.76	---	---
11AC40SISO	Ant1	5310	44.32	5287.76	5332.08	---	---
11AC40SISO	Ant1	5510	46.16	5486.40	5532.56	---	---
11AC40SISO	Ant1	5550	44.32	5528.56	5572.88	---	---
11AC40SISO	Ant1	5670	45.84	5647.52	5693.36	---	---
11AC40SISO	Ant1	5755	45.28	5732.36	5777.64	---	---
11AC40SISO	Ant1	5795	45.12	5772.12	5817.24	---	---
11AC80SISO	Ant1	5210	86.40	5167.44	5253.84	---	---
11AC80SISO	Ant1	5290	85.92	5247.76	5333.68	---	---
11AC80SISO	Ant1	5530	84.96	5488.08	5573.04	---	---
11AC80SISO	Ant1	5610	86.08	5568.40	5654.48	---	---
11AC80SISO	Ant1	5775	87.04	5731.64	5818.68	---	---
11AX20SISO	Ant1	5180	24.04	5167.56	5191.60	---	---
11AX20SISO	Ant1	5200	24.44	5188.44	5212.88	---	---
11AX20SISO	Ant1	5240	24.92	5228.60	5253.52	---	---
11AX20SISO	Ant1	5260	24.16	5248.20	5272.36	---	---
11AX20SISO	Ant1	5280	24.20	5267.40	5291.60	---	---
11AX20SISO	Ant1	5320	23.28	5308.24	5331.52	---	---
11AX20SISO	Ant1	5500	26.20	5488.76	5514.96	---	---
11AX20SISO	Ant1	5580	24.16	5568.40	5592.56	---	---


Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


11AX20SISO	Ant1	5700	23.96	5687.52	5711.48	---	---
11AX20SISO	Ant1	5745	23.24	5733.56	5756.80	---	---
11AX20SISO	Ant1	5785	27.12	5772.56	5799.68	---	---
11AX20SISO	Ant1	5825	27.12	5813.56	5840.68	---	---
11AX40SISO	Ant1	5190	45.28	5167.04	5212.32	---	---
11AX40SISO	Ant1	5230	44.32	5208.32	5252.64	---	---
11AX40SISO	Ant1	5270	45.28	5247.04	5292.32	---	---
11AX40SISO	Ant1	5310	44.48	5288.56	5333.04	---	---
11AX40SISO	Ant1	5510	44.72	5488.08	5532.80	---	---
11AX40SISO	Ant1	5550	43.28	5528.16	5571.44	---	---
11AX40SISO	Ant1	5670	44.80	5648.08	5692.88	---	---
11AX40SISO	Ant1	5755	42.96	5733.24	5776.20	---	---
11AX40SISO	Ant1	5795	45.04	5772.20	5817.24	---	---
11AX80SISO	Ant1	5210	84.48	5167.92	5252.40	---	---
11AX80SISO	Ant1	5290	87.36	5245.04	5332.40	---	---
11AX80SISO	Ant1	5530	83.84	5488.08	5571.92	---	---
11AX80SISO	Ant1	5610	85.28	5567.12	5652.40	---	---
11AX80SISO	Ant1	5775	87.36	5731.48	5818.84	---	---


Test Graphs

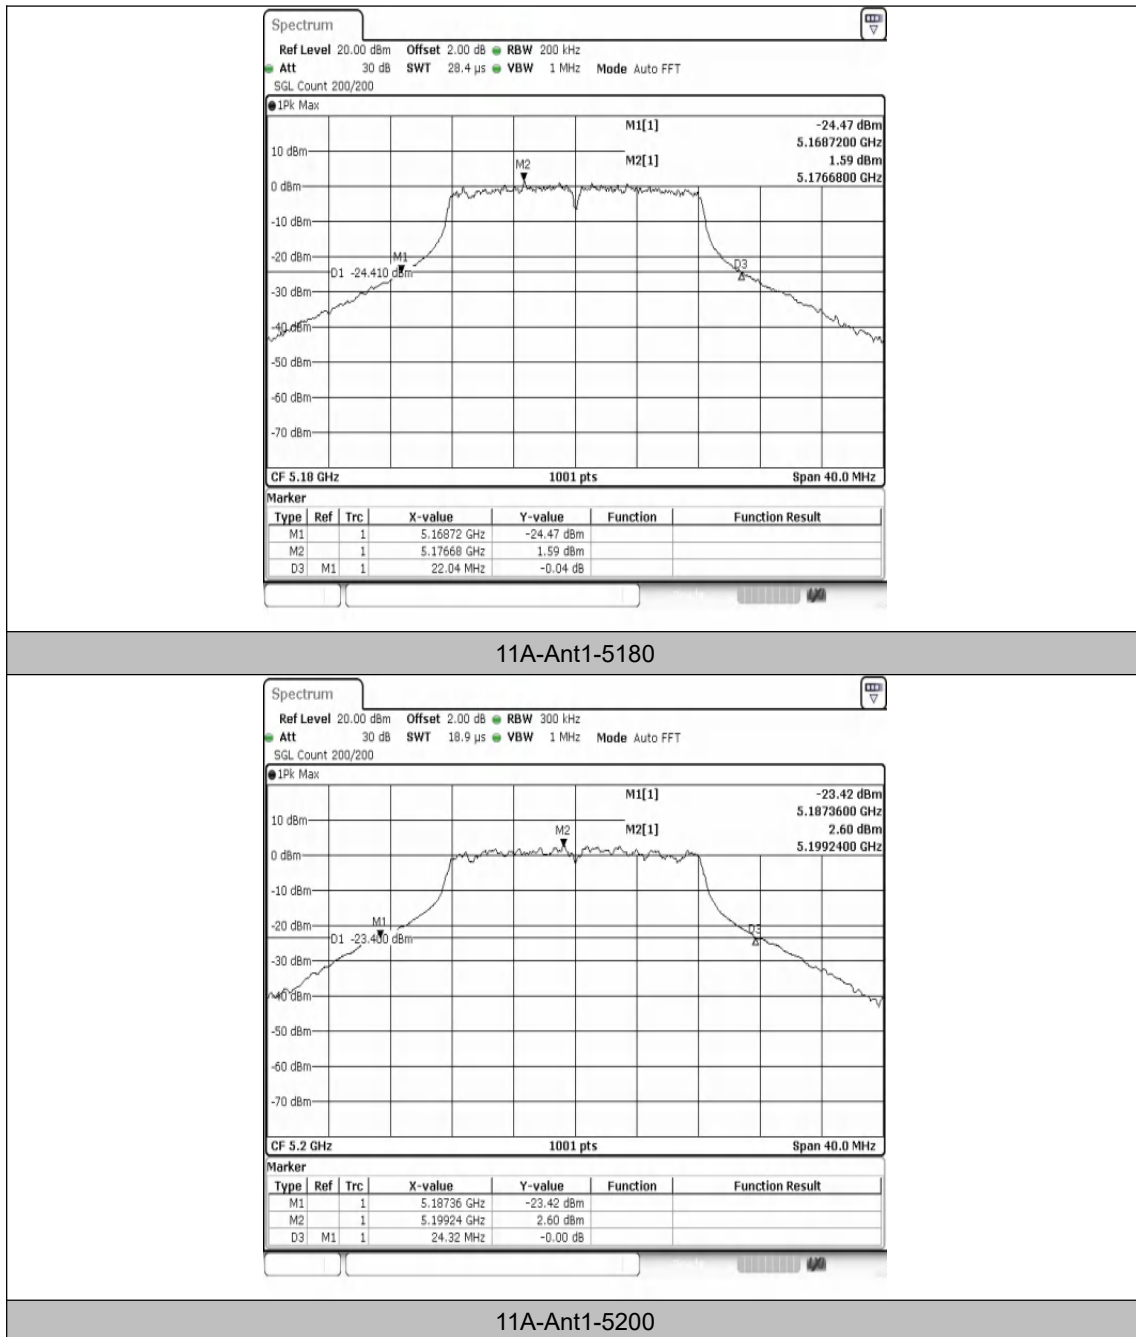


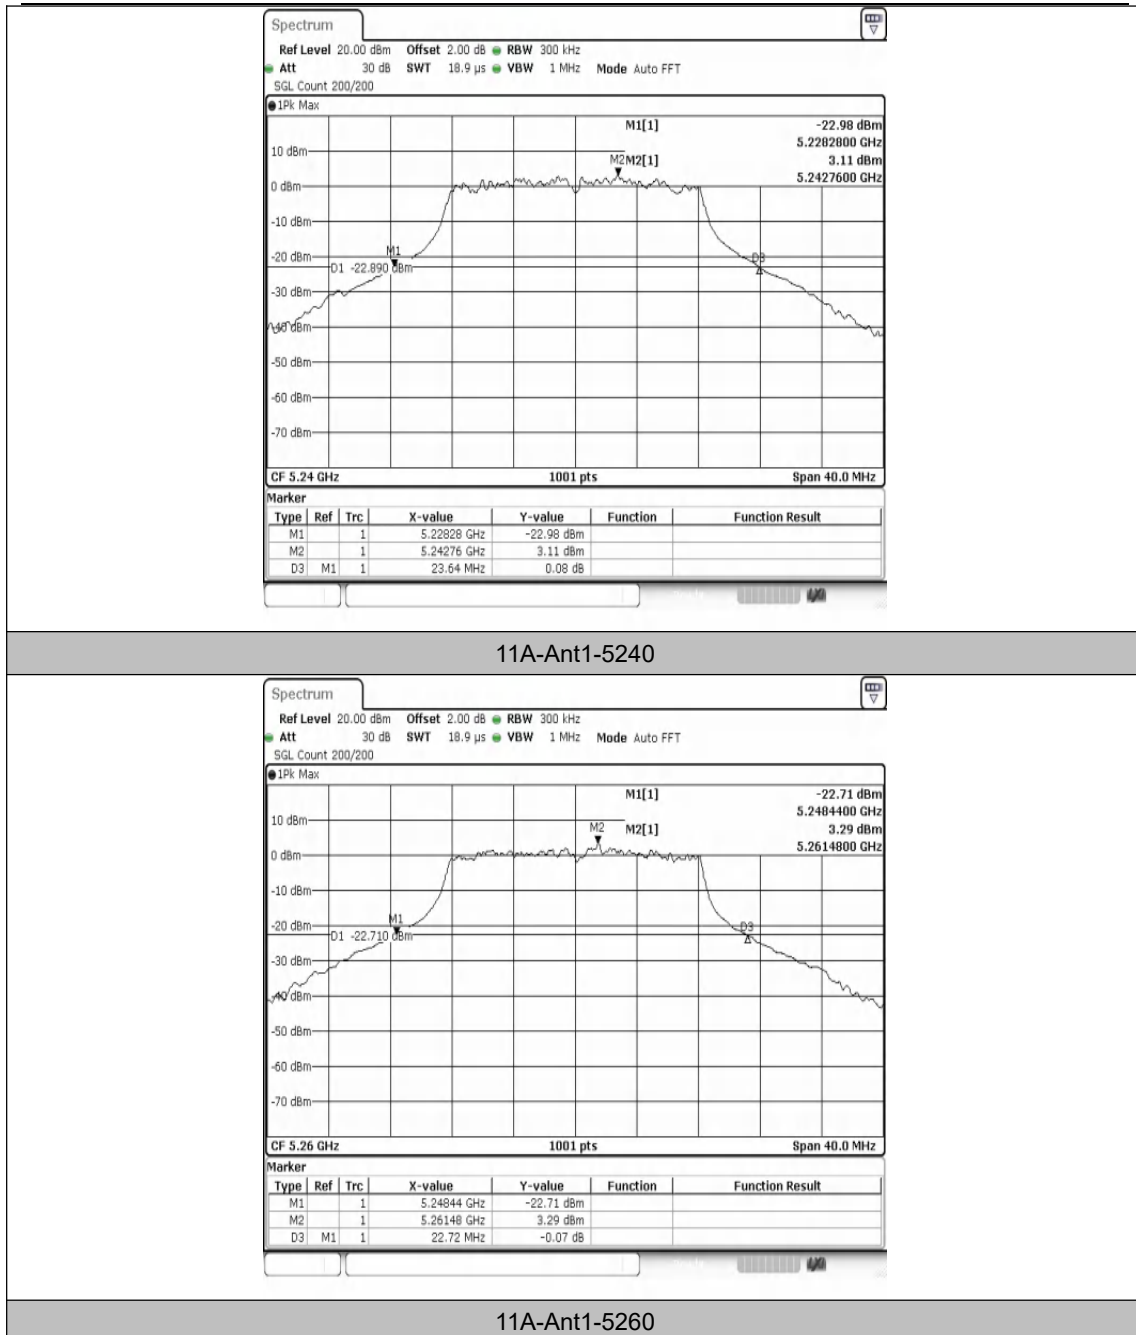


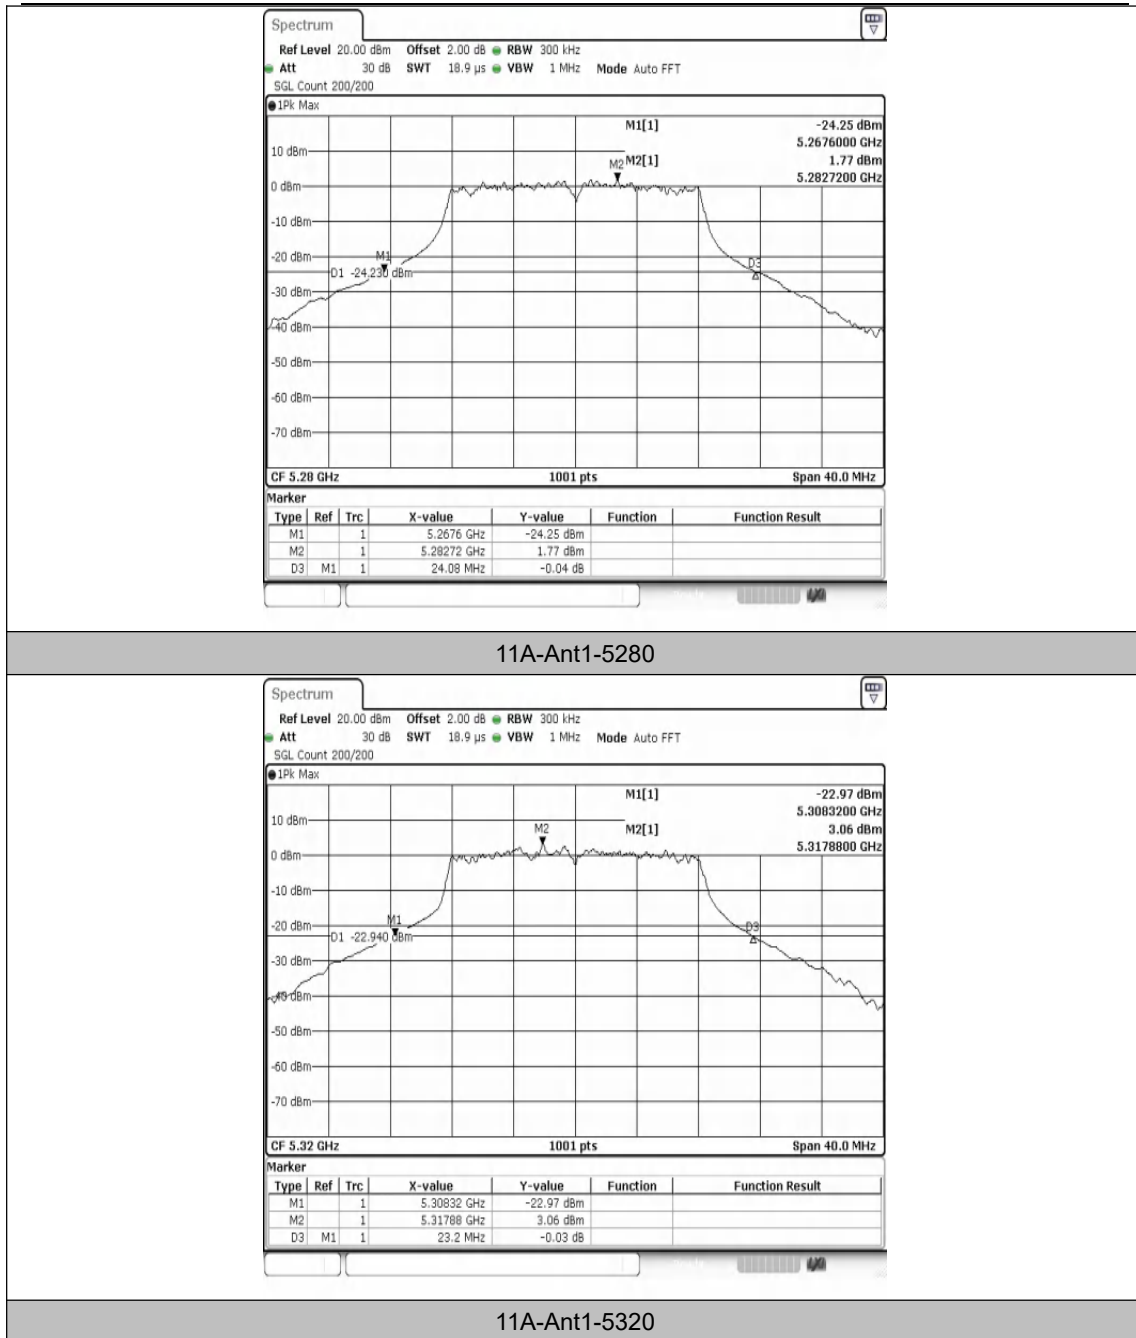


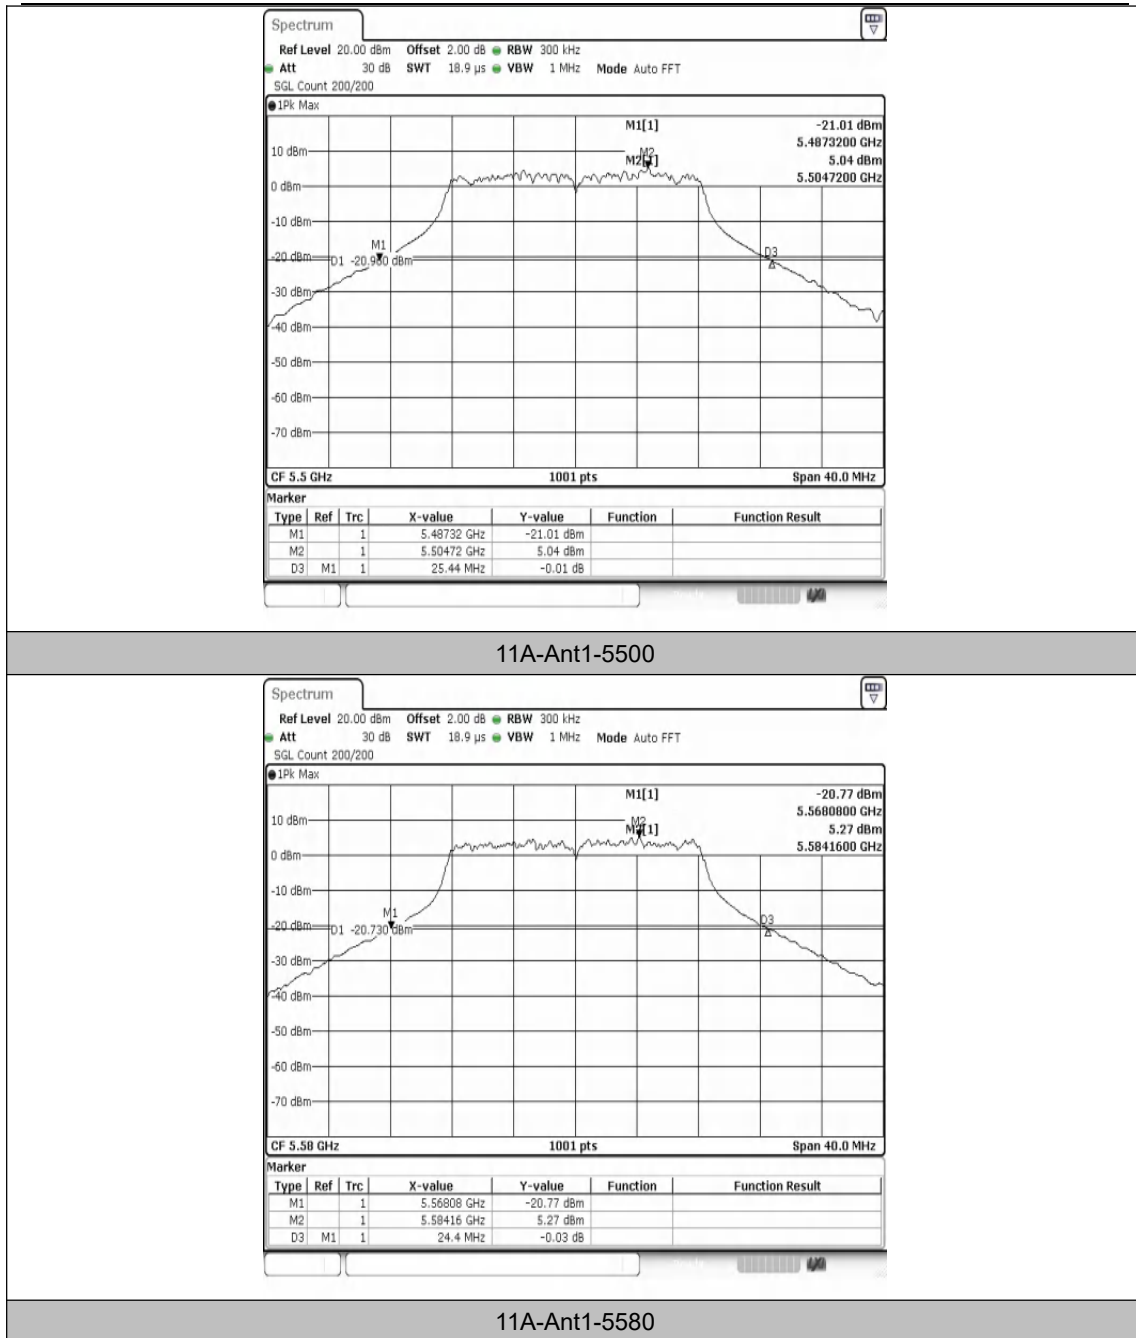


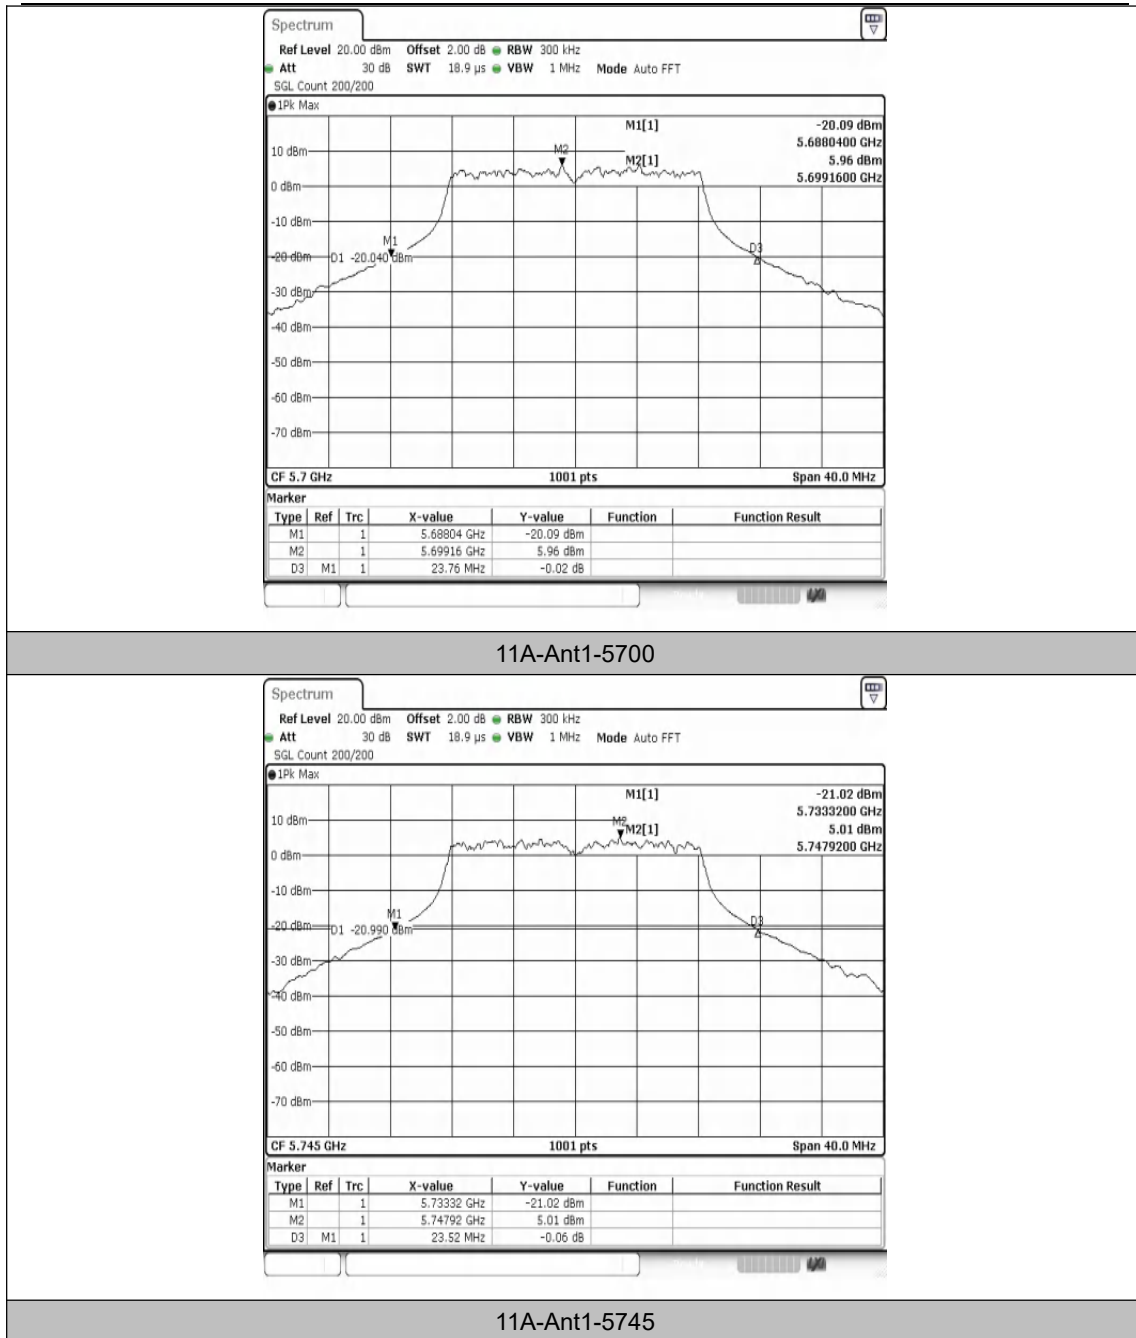


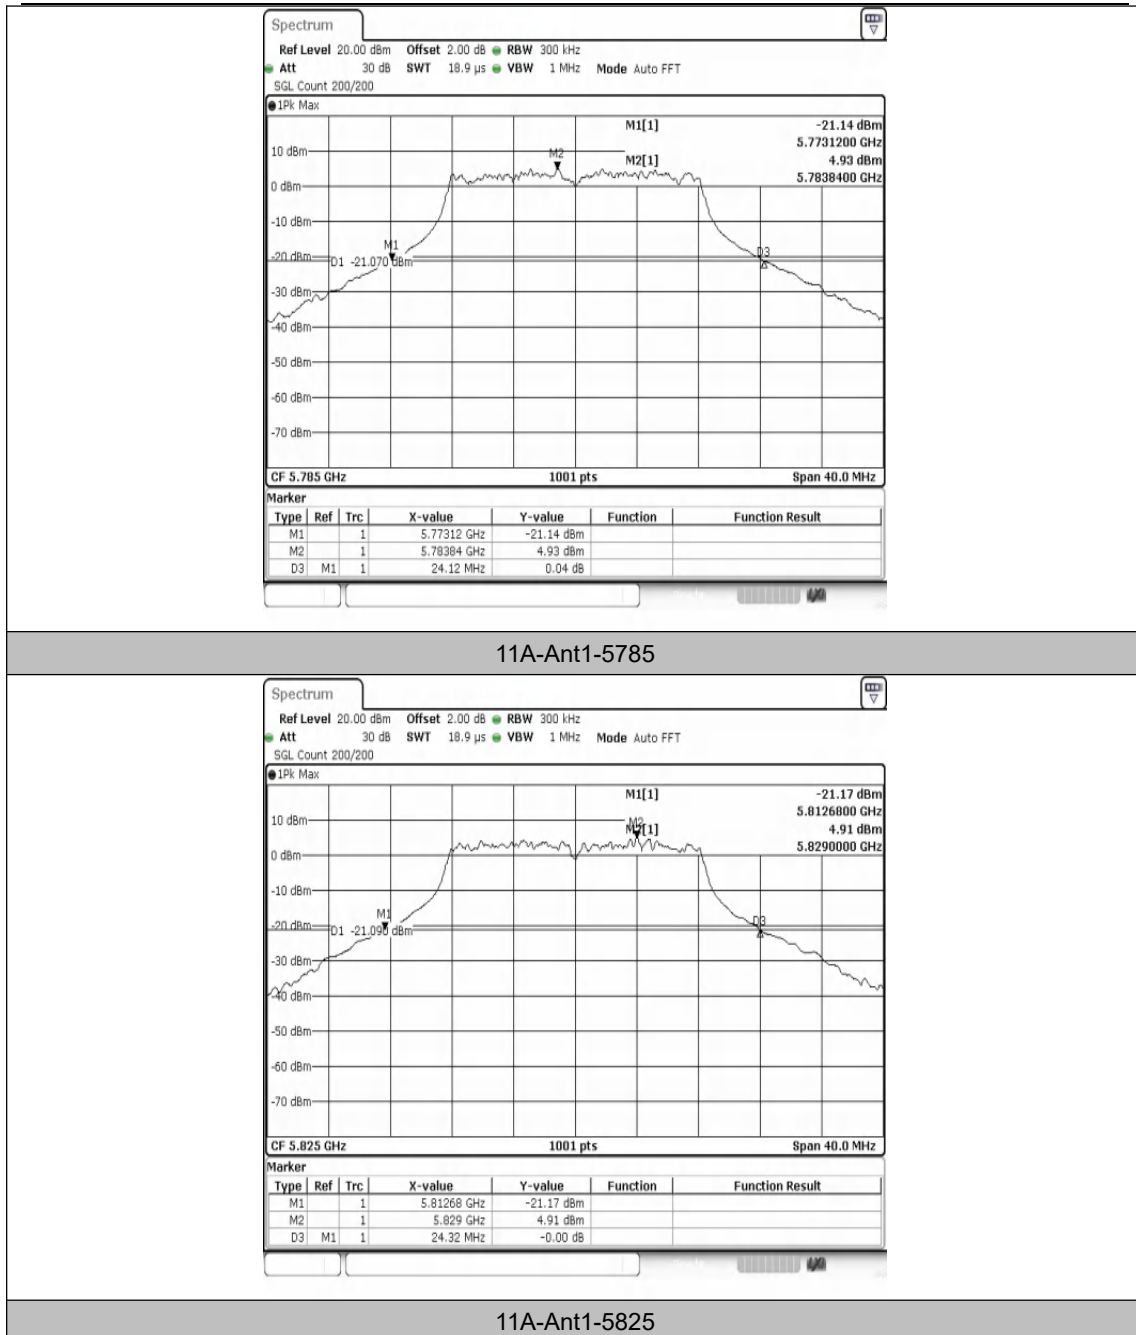


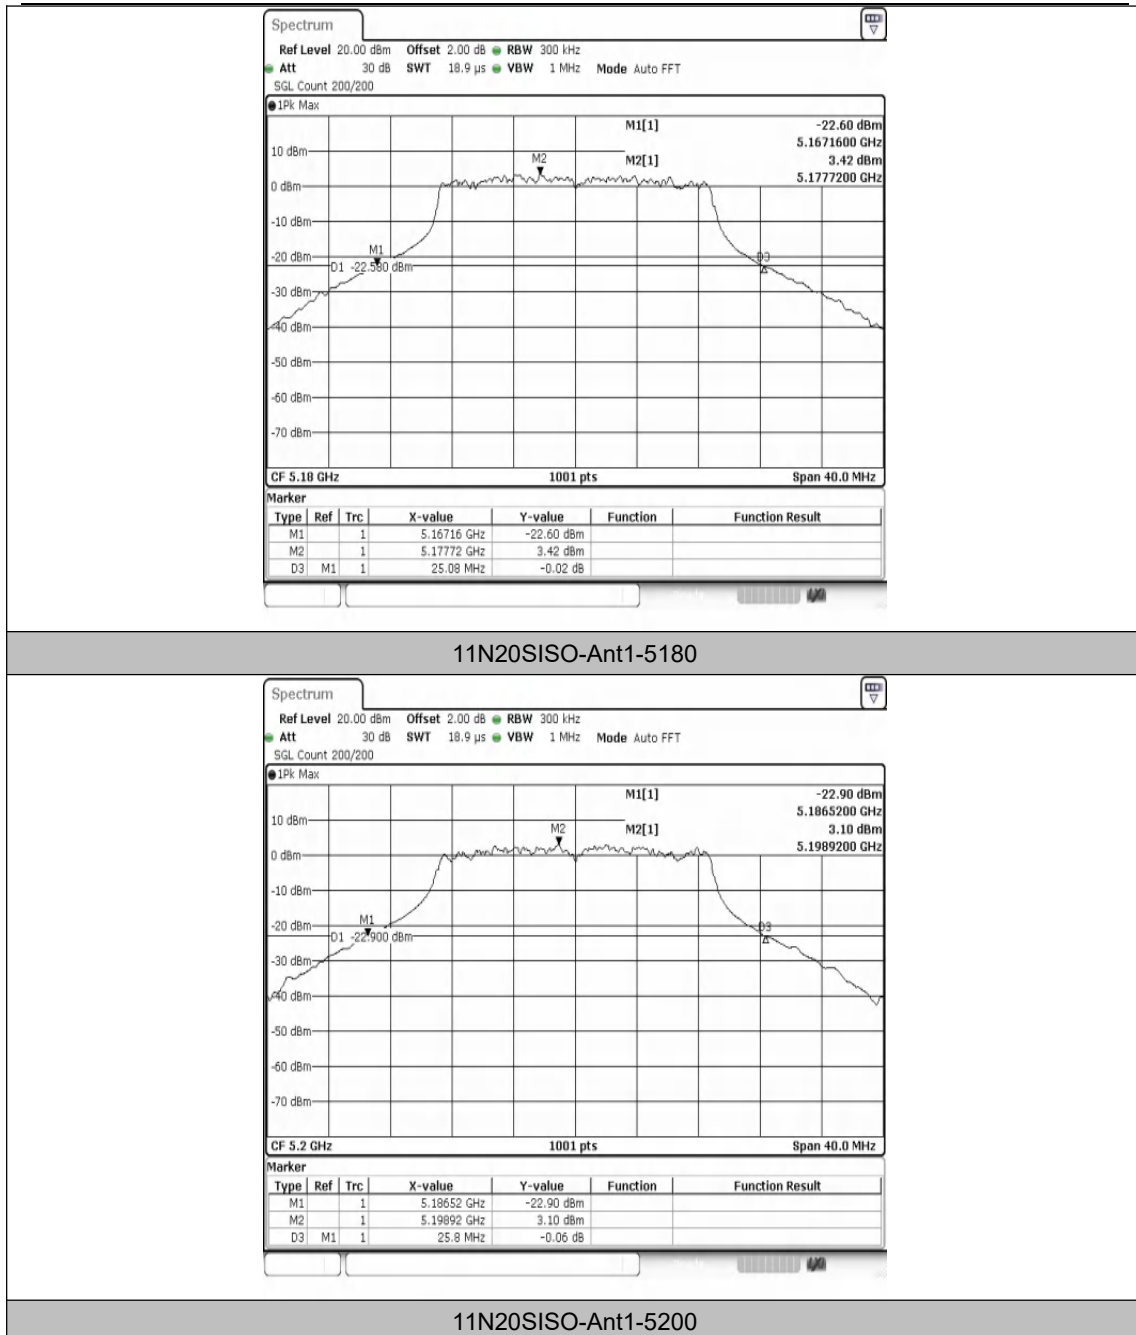


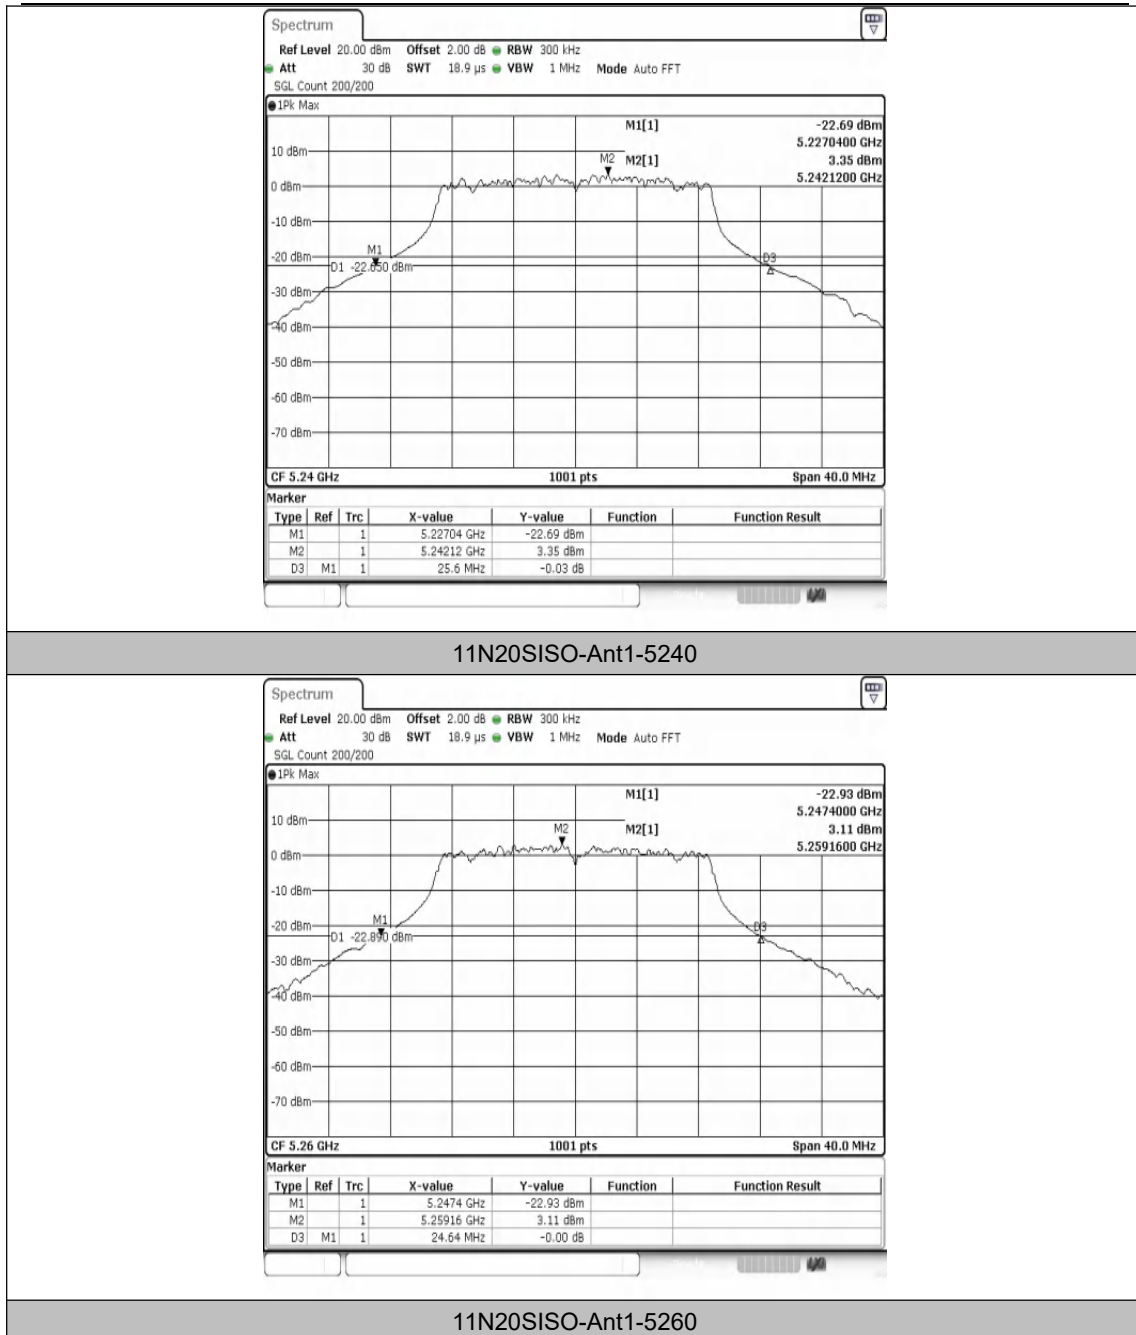


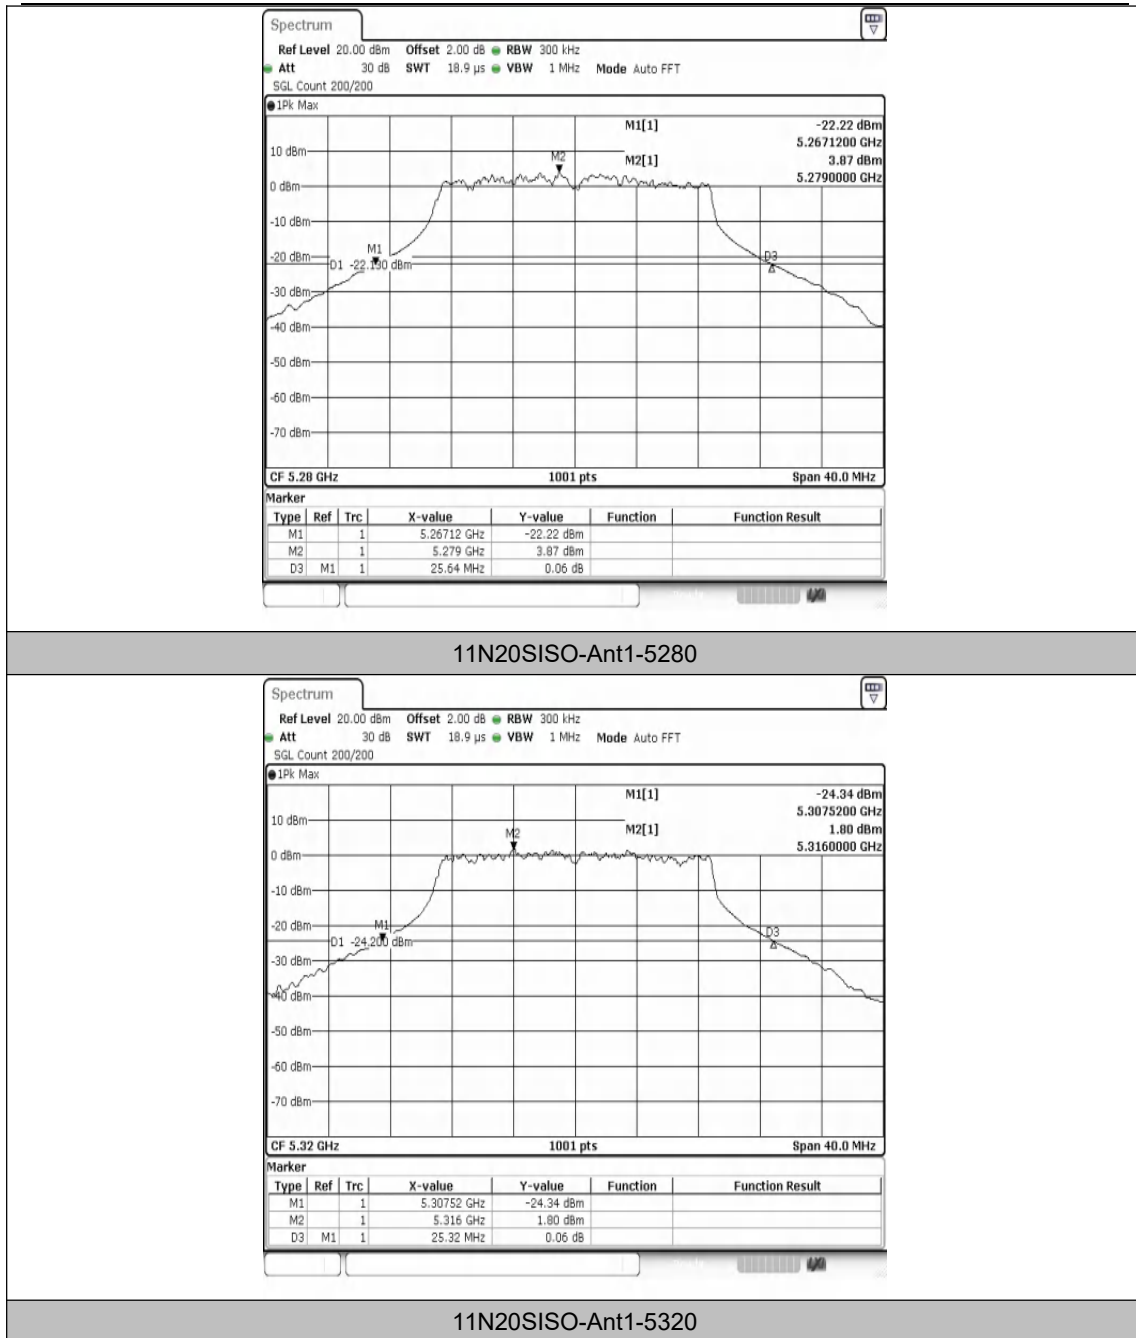


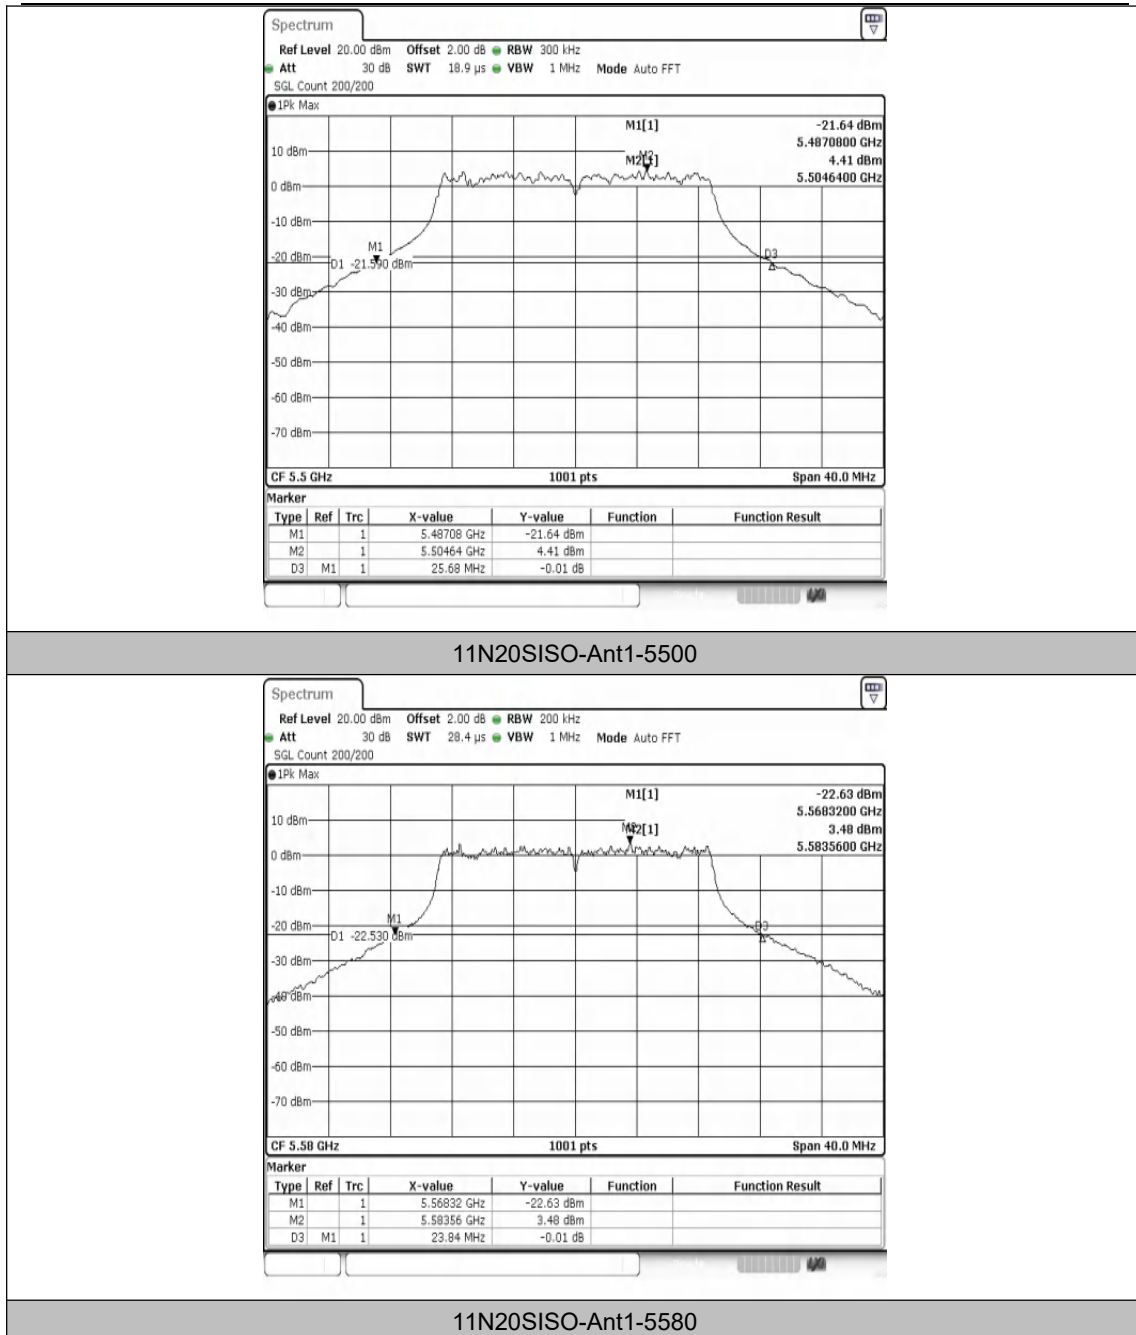


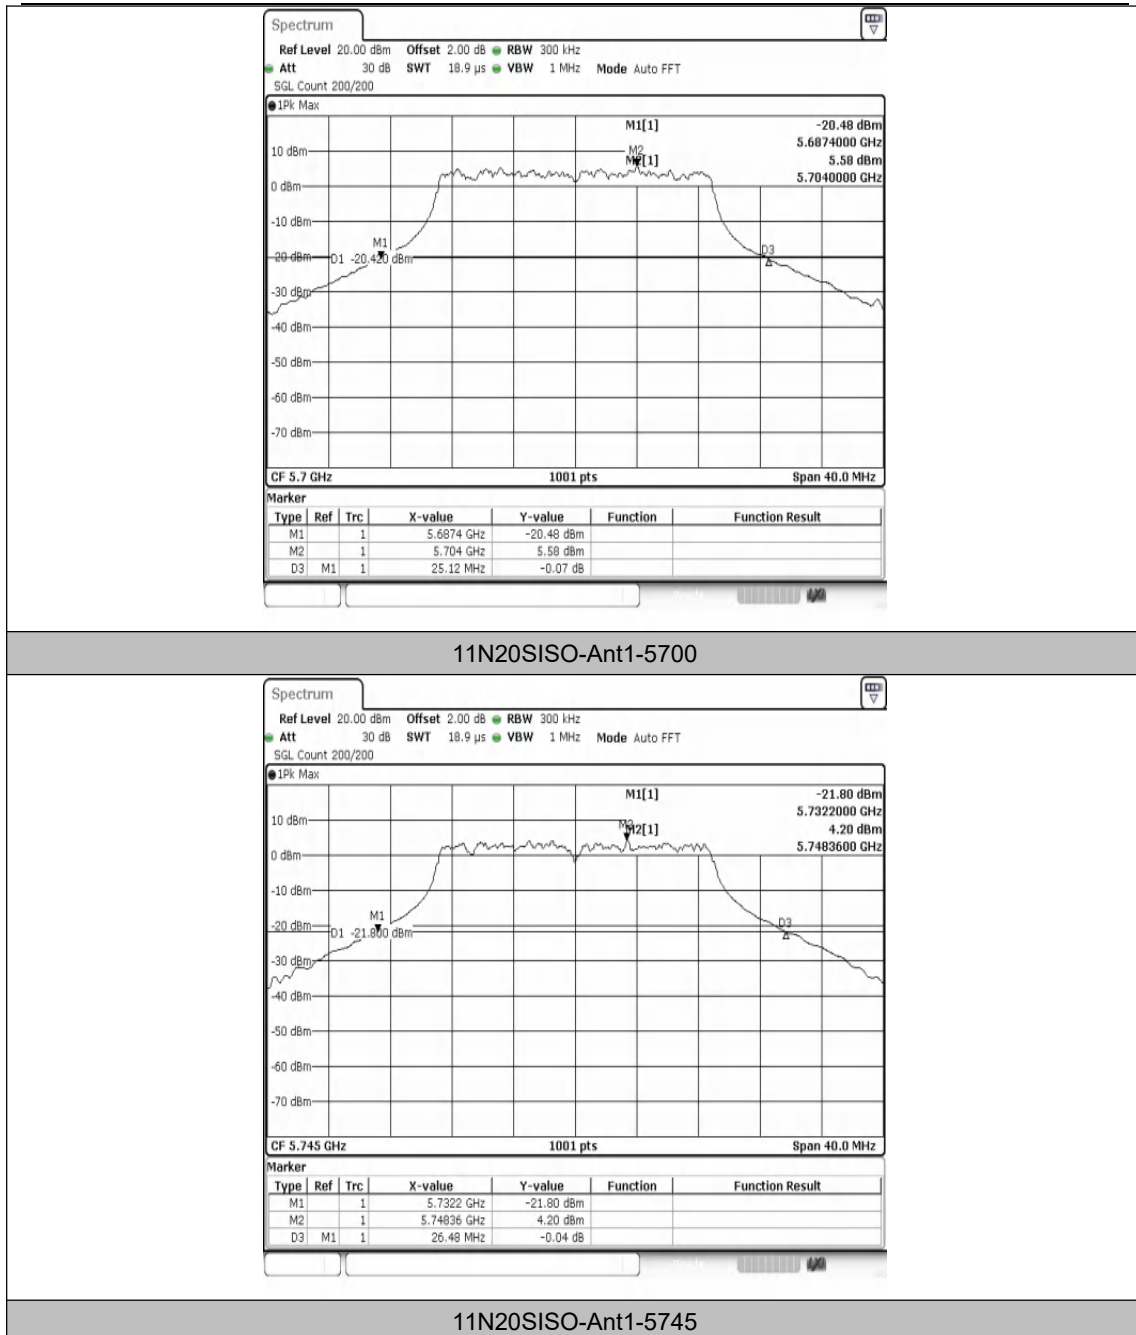

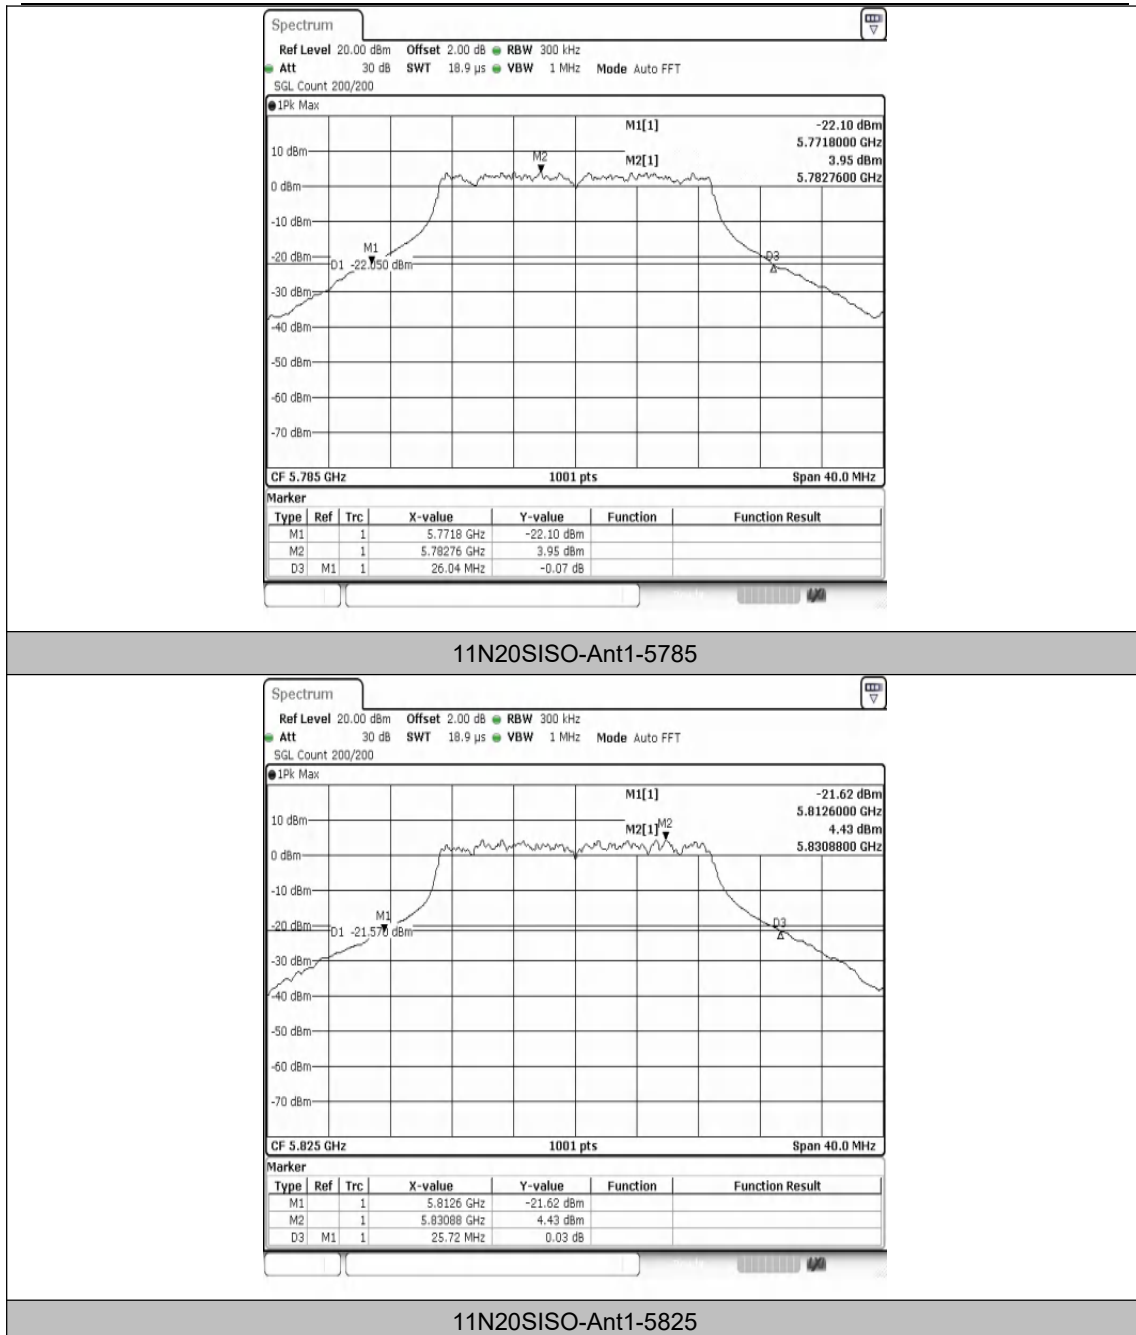

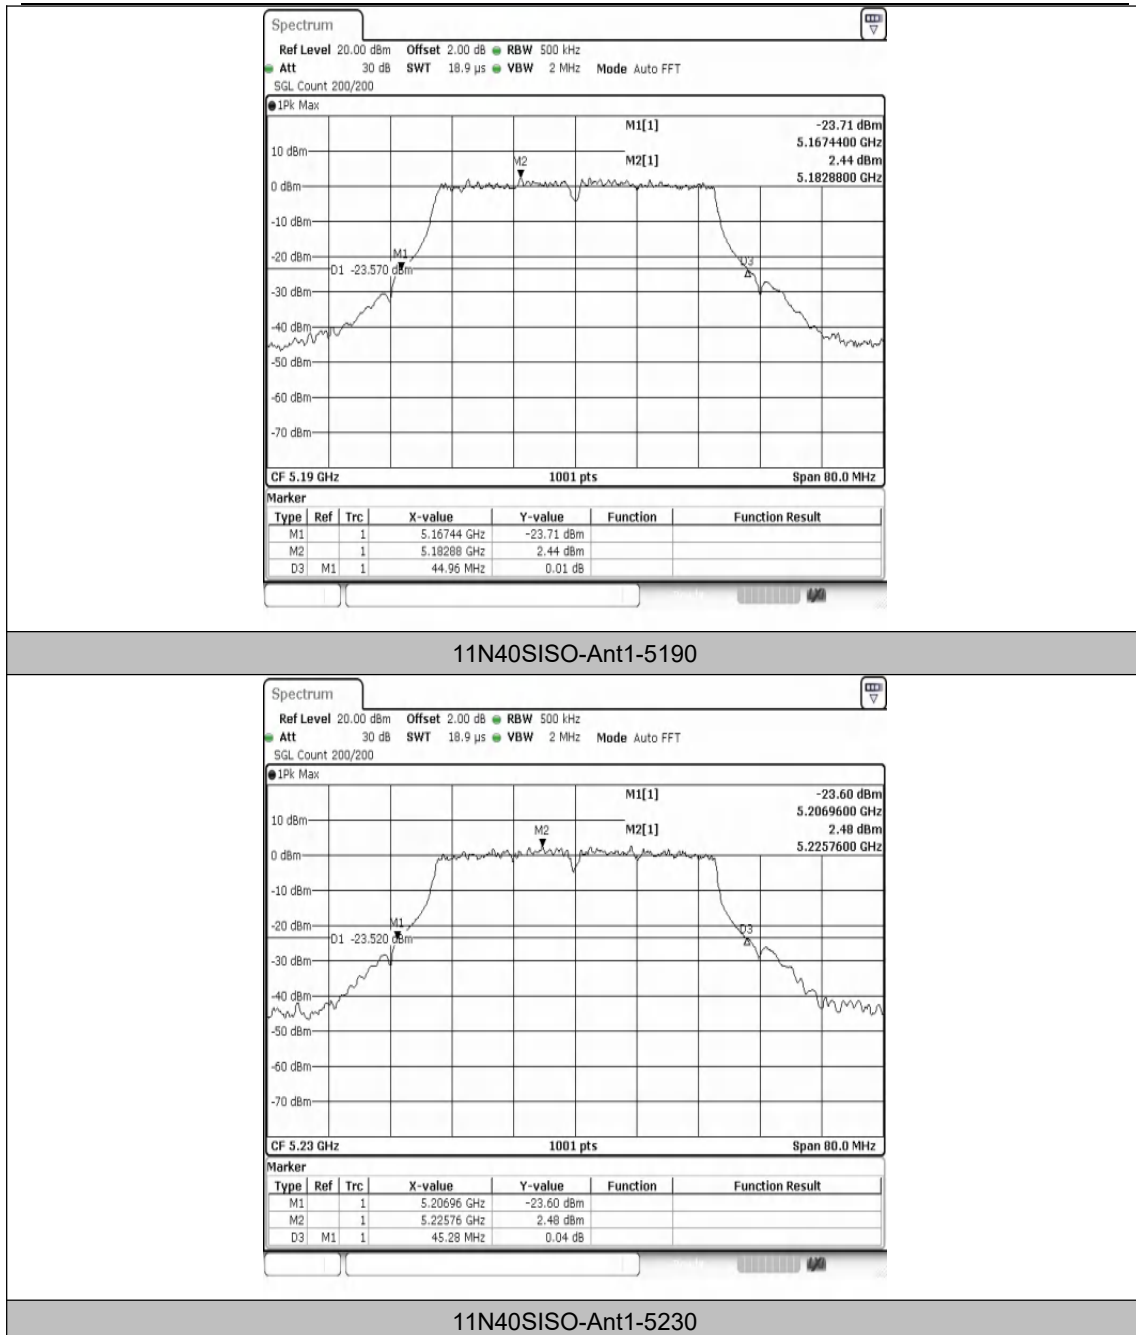

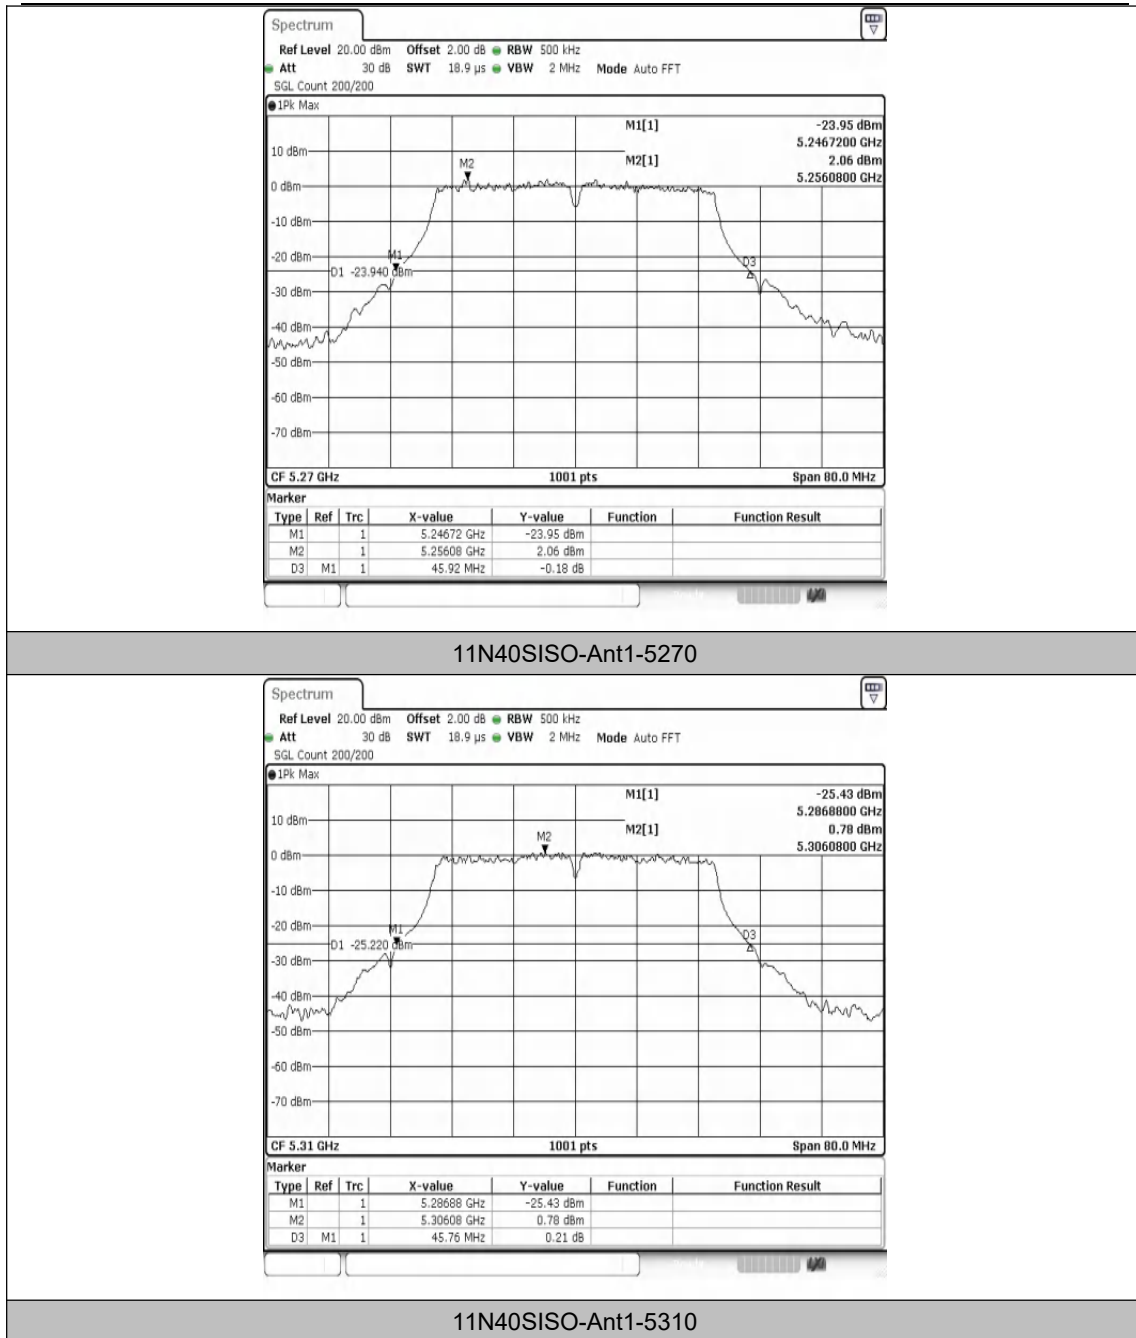


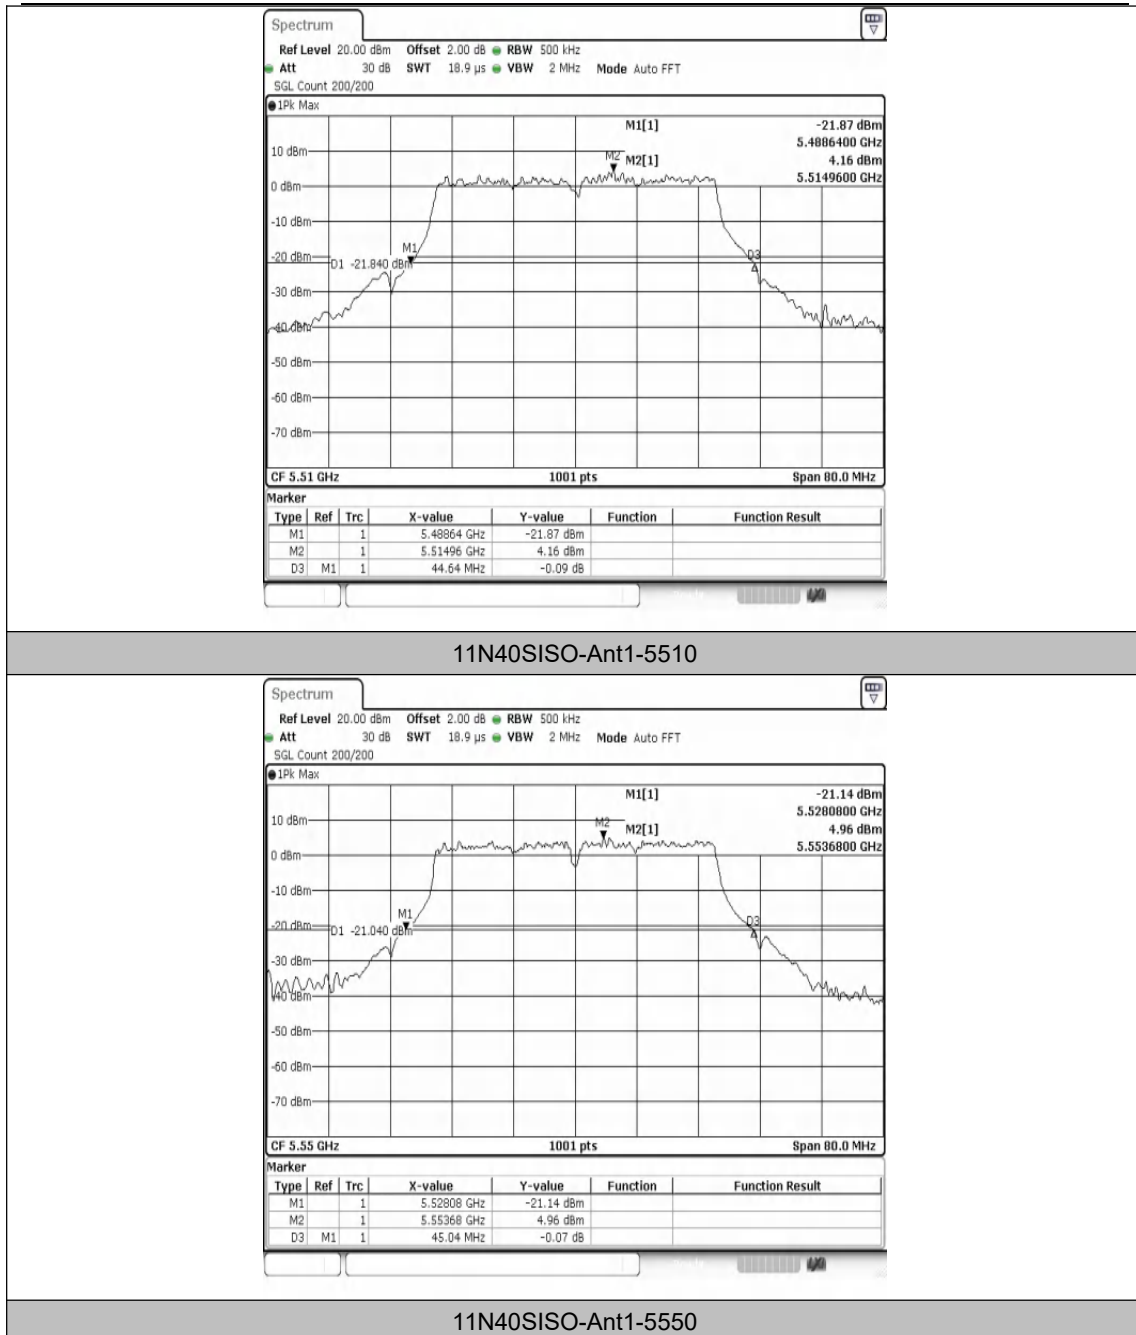

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

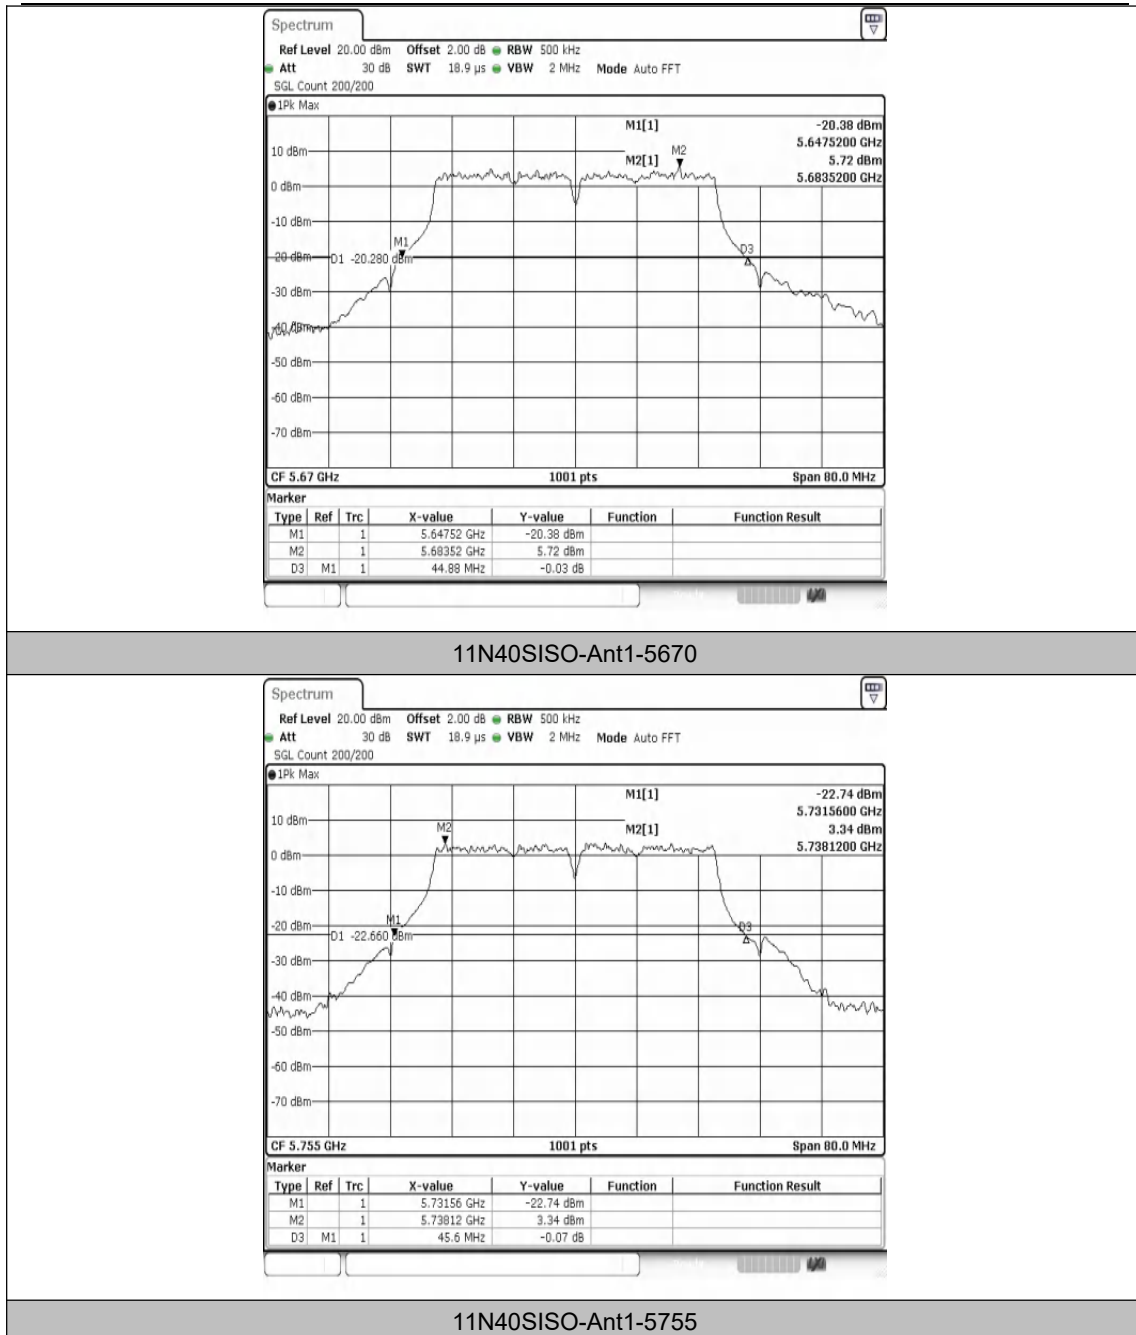



Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

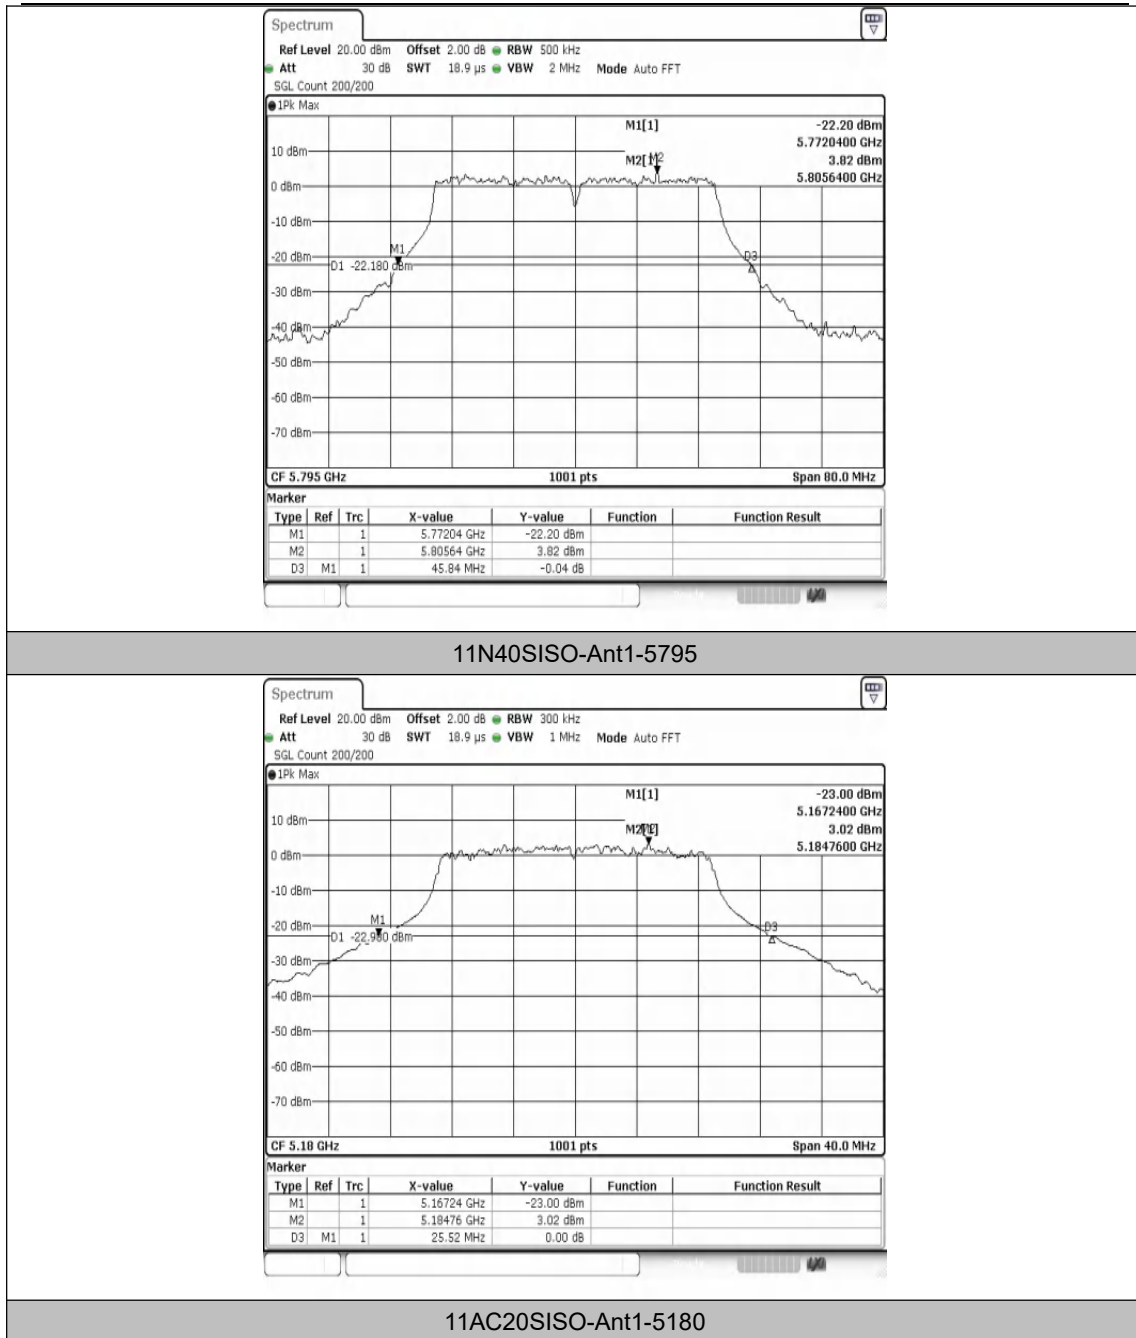


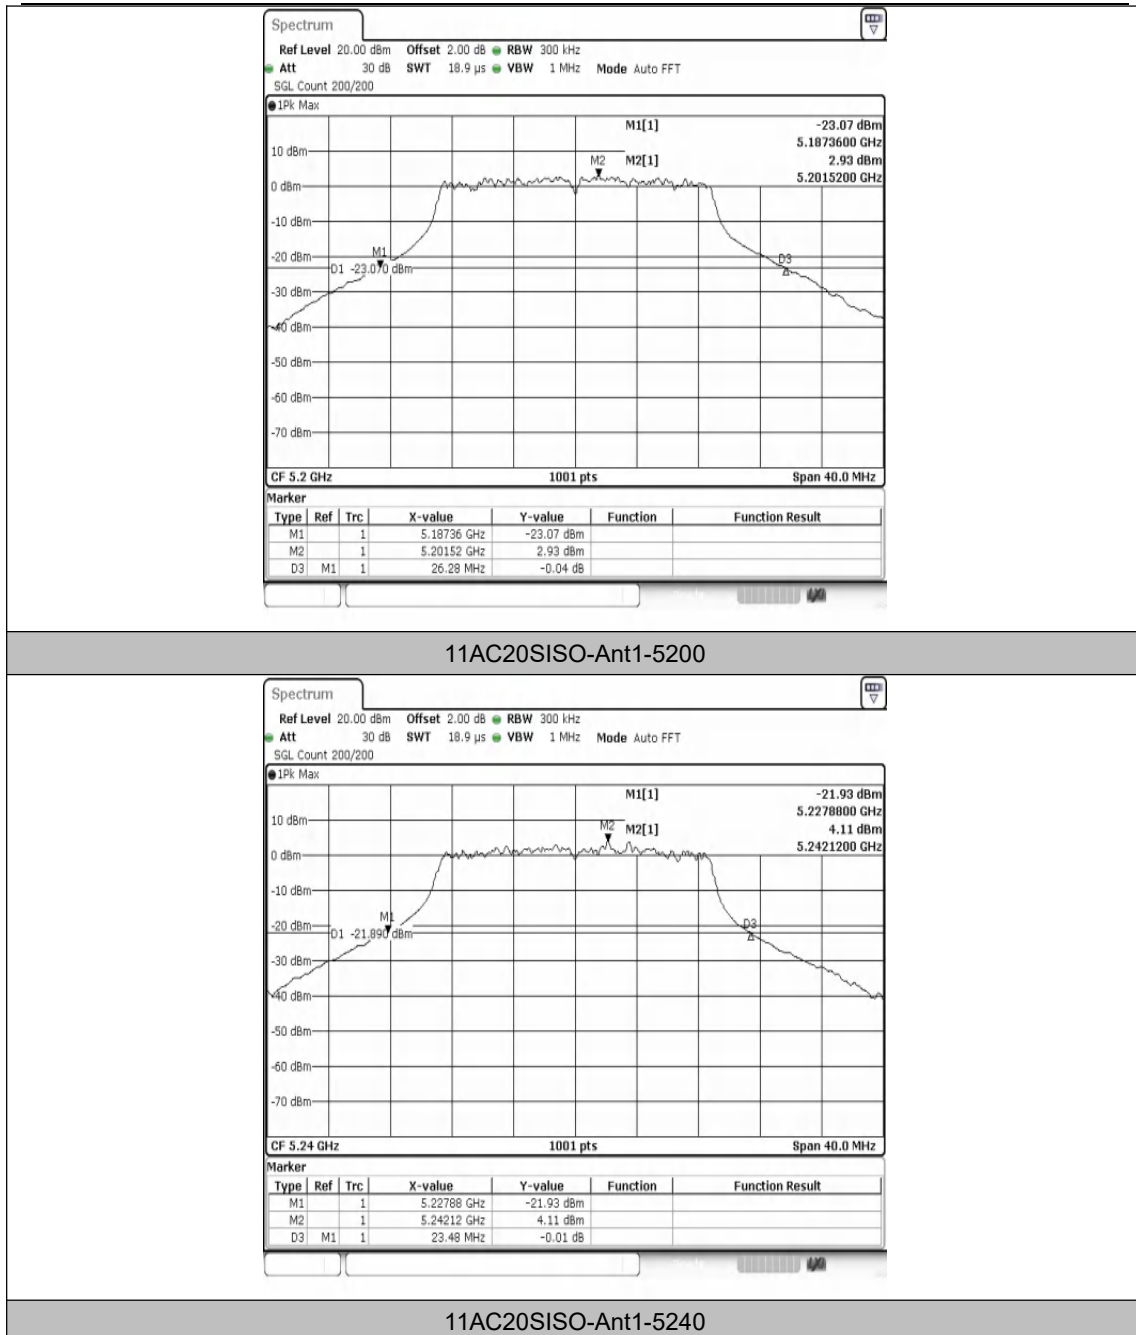


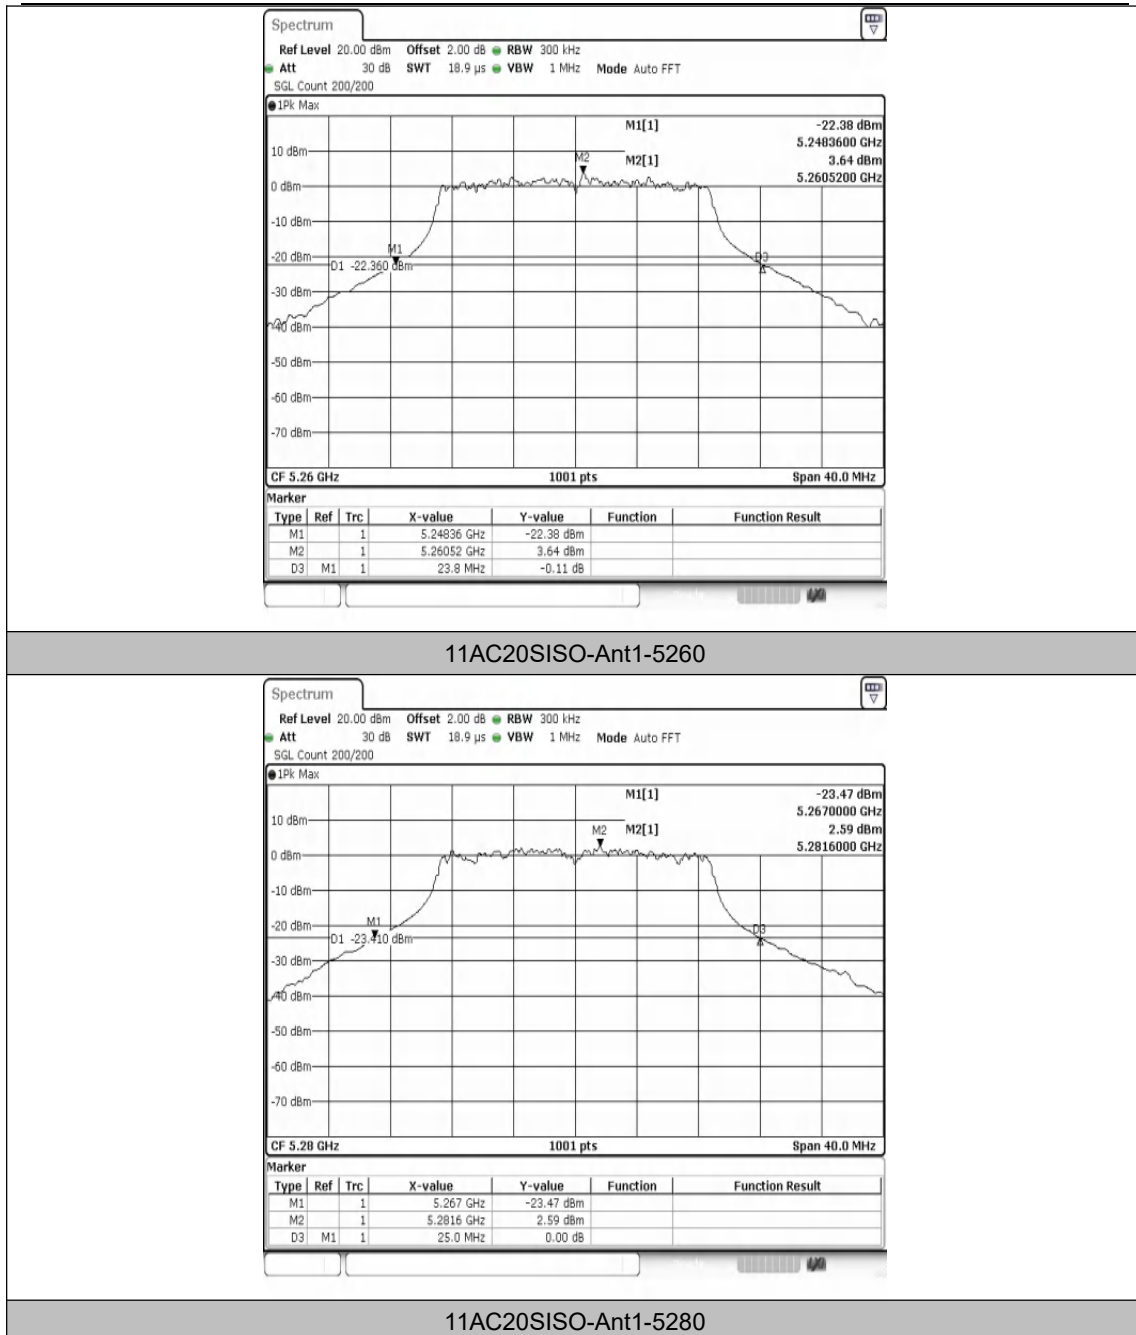


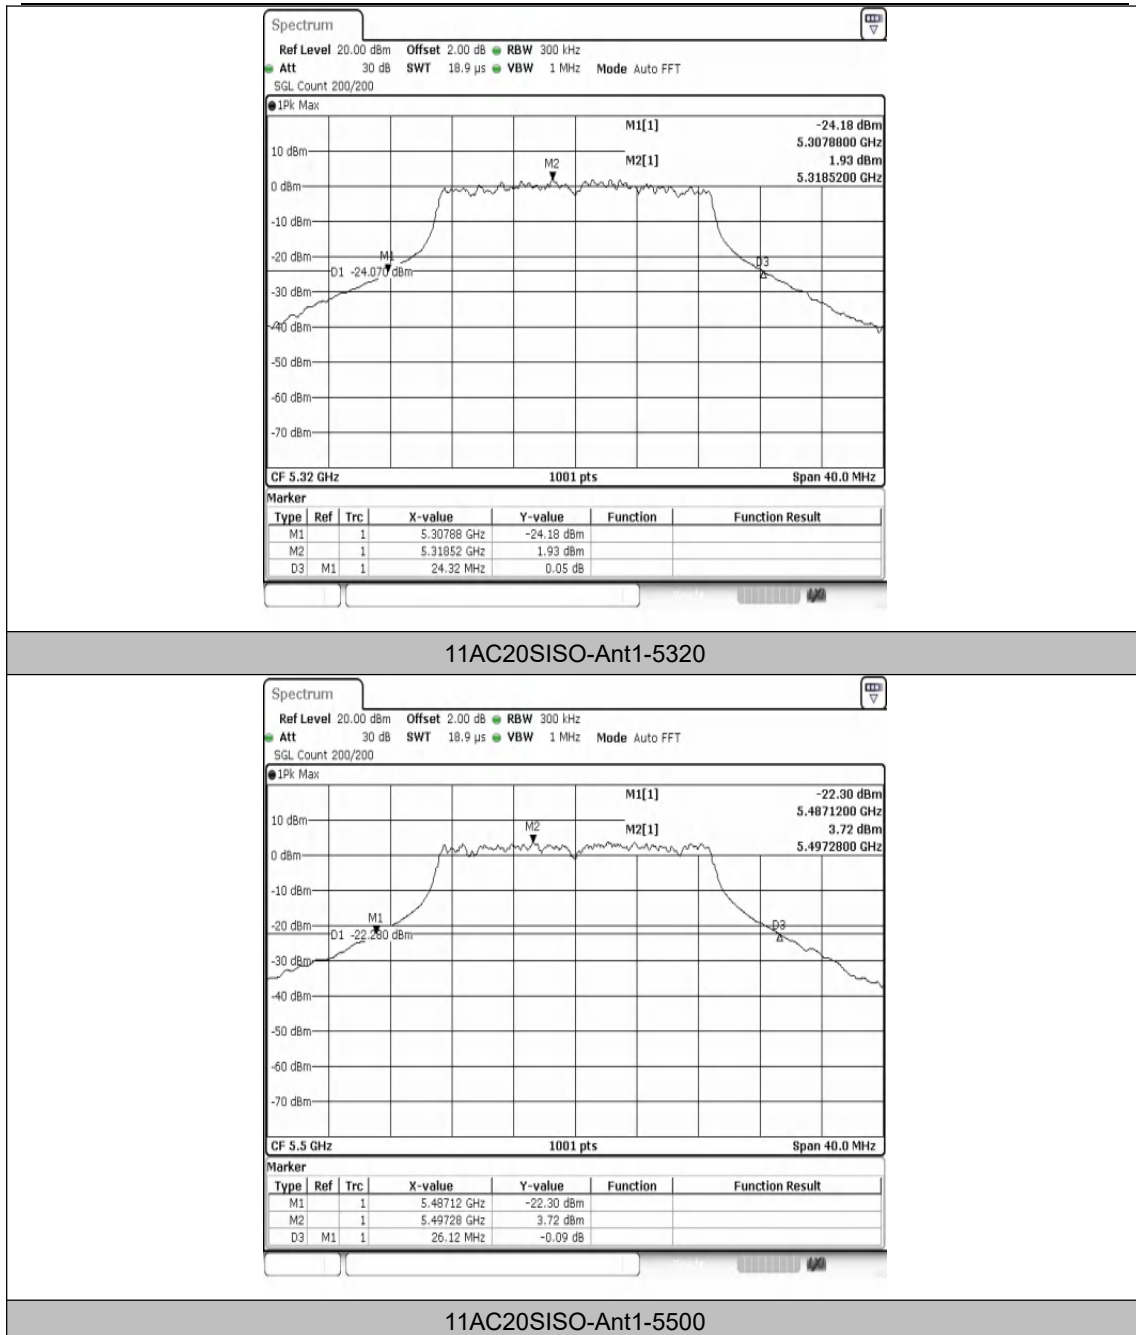


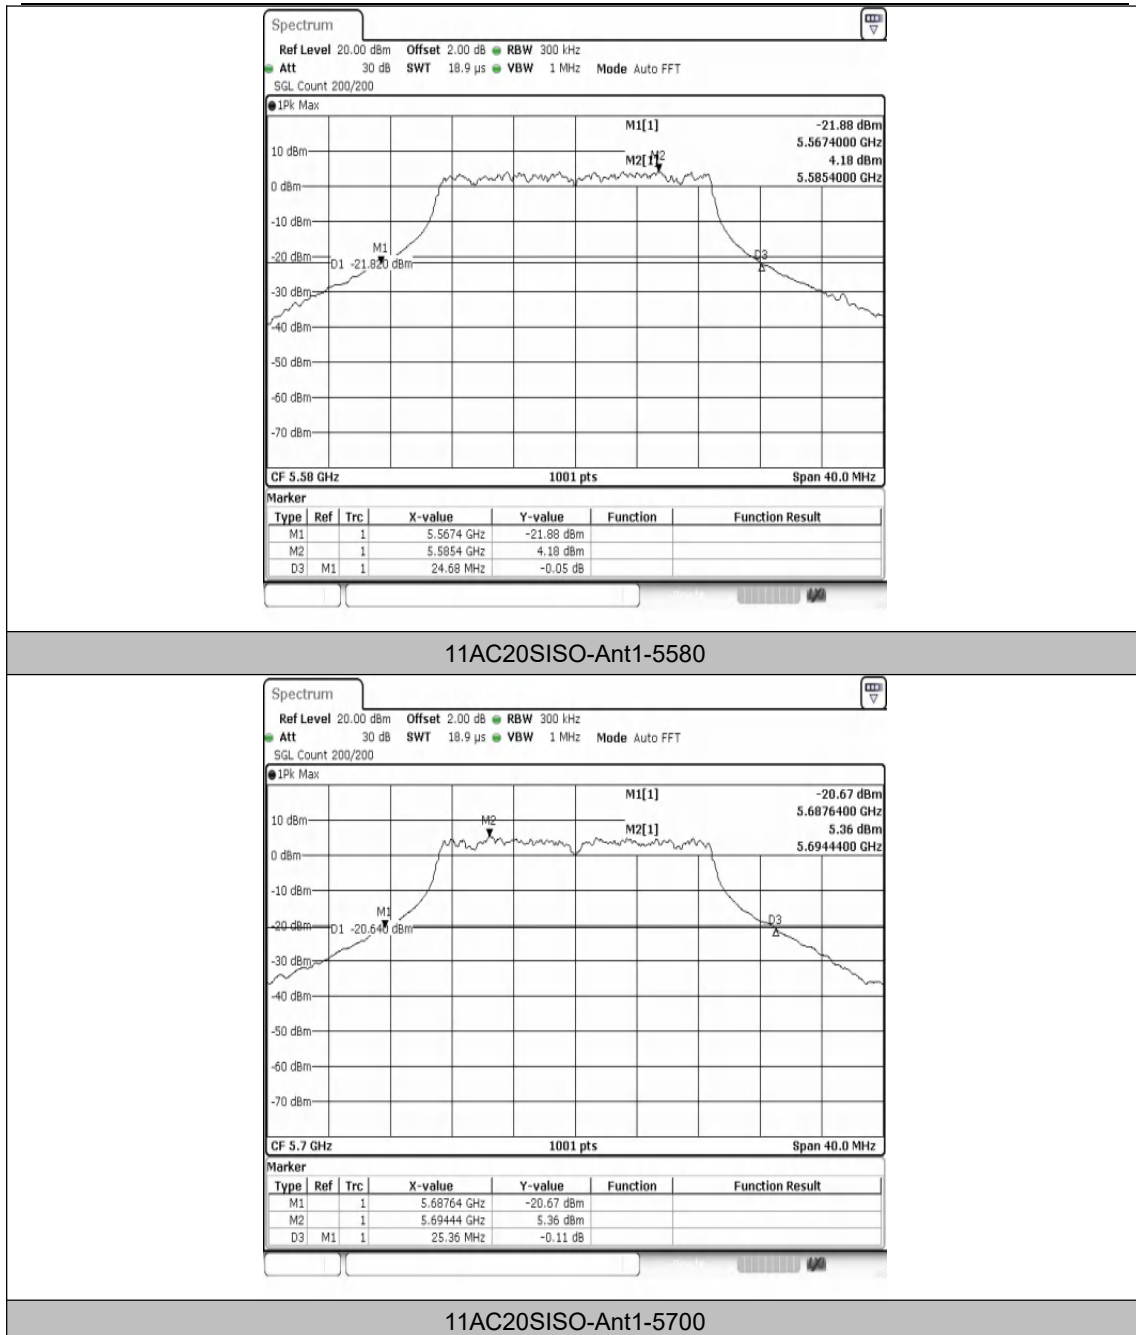


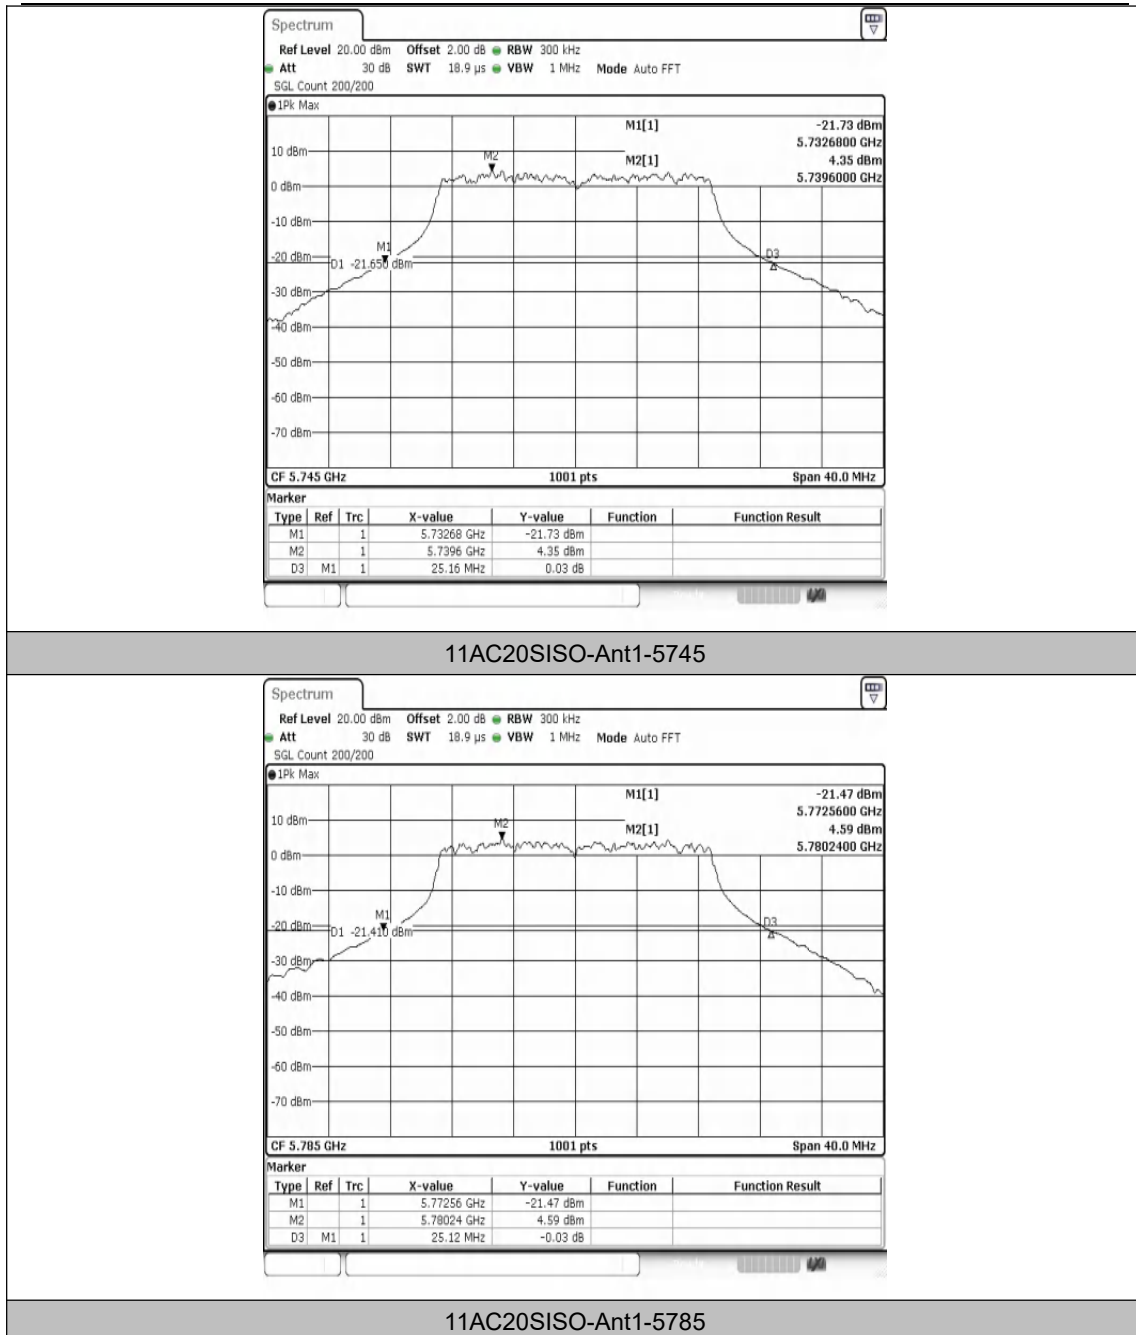


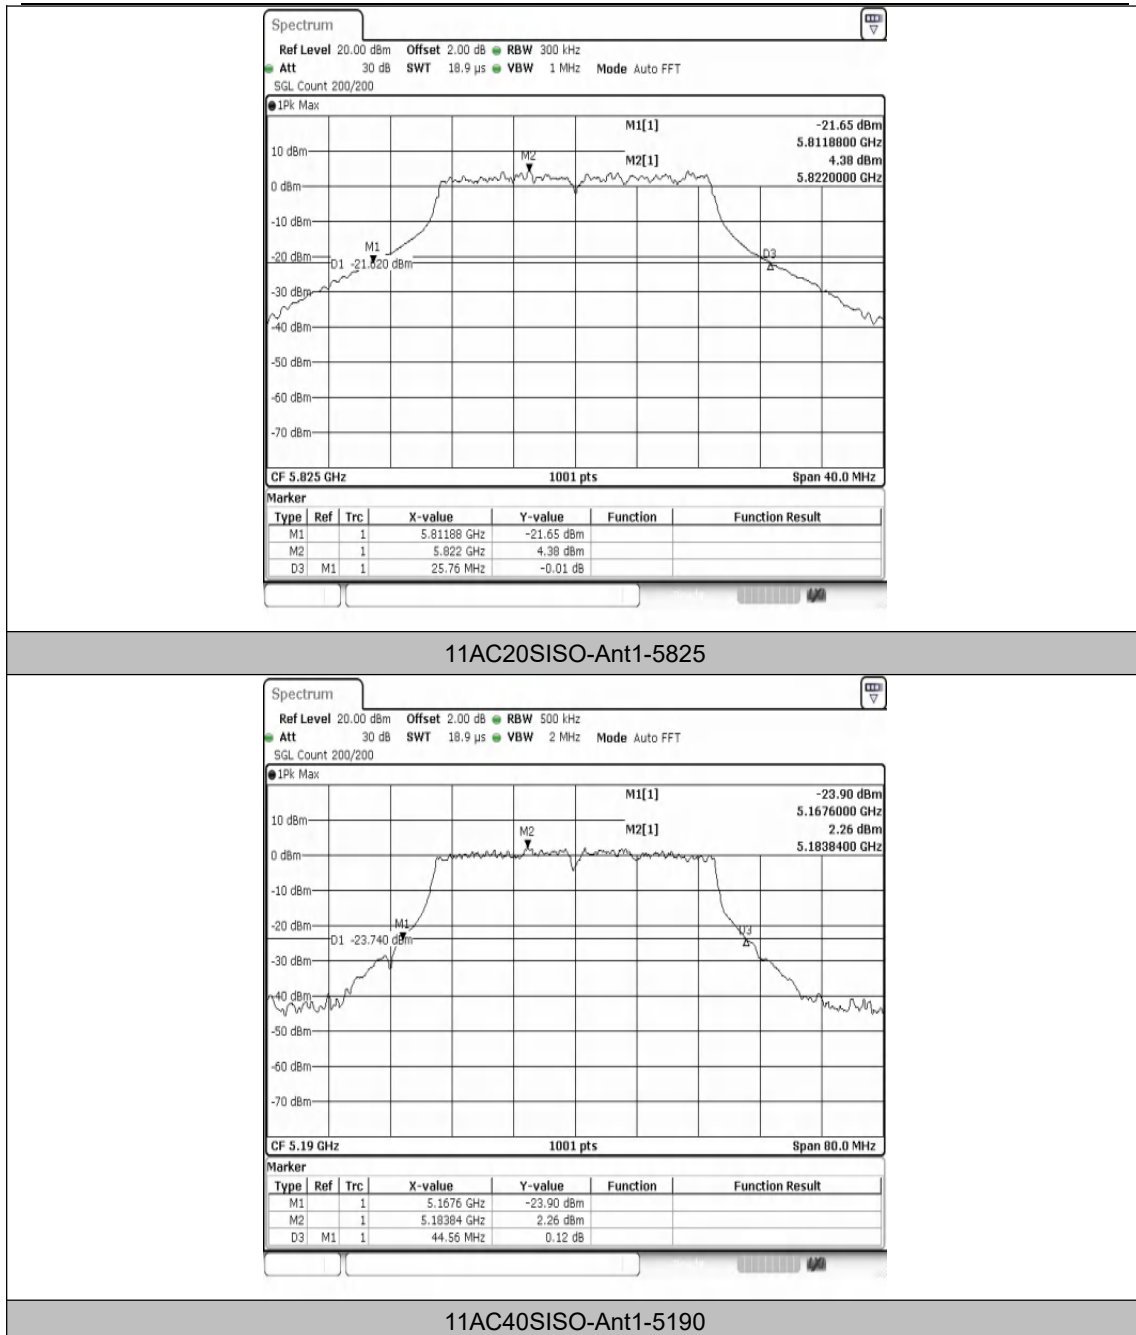


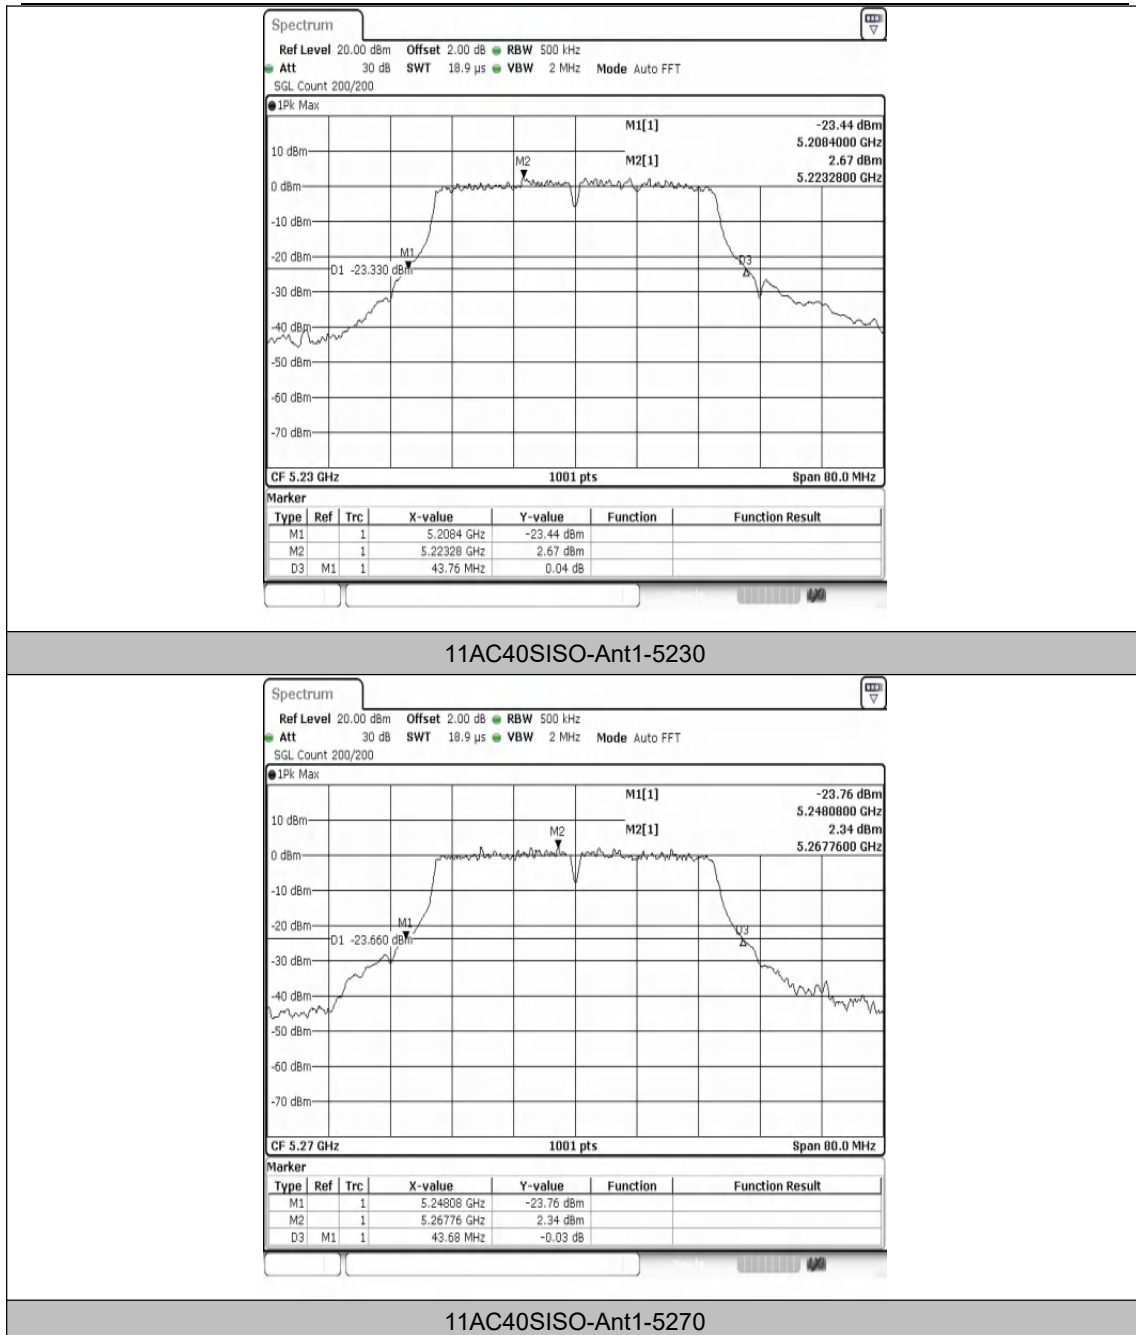


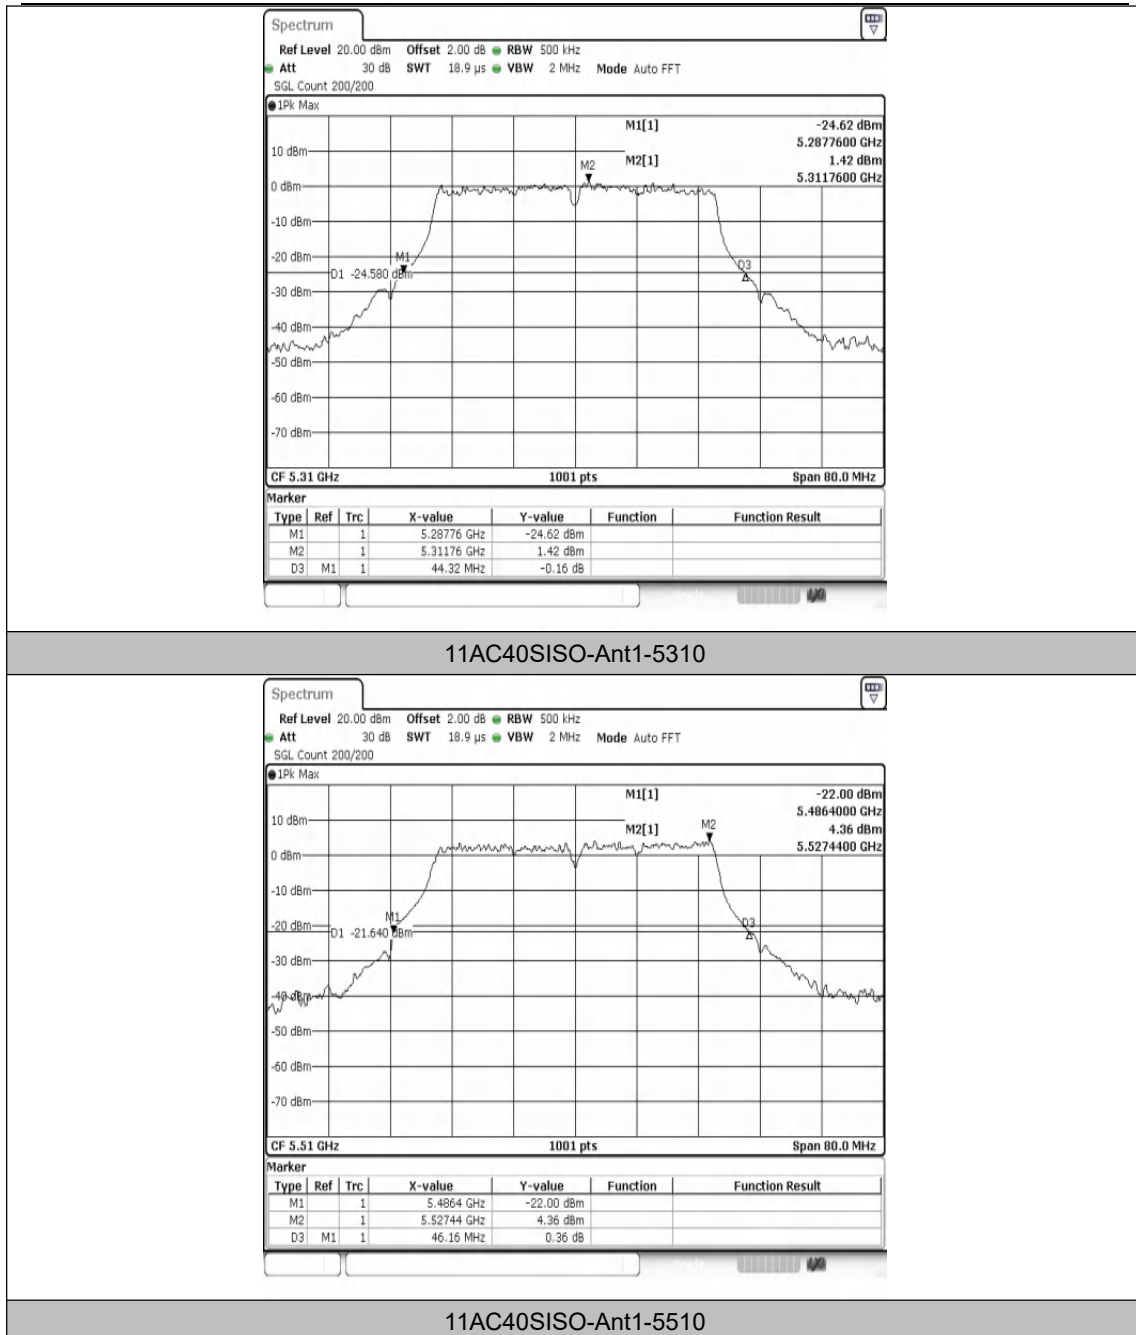


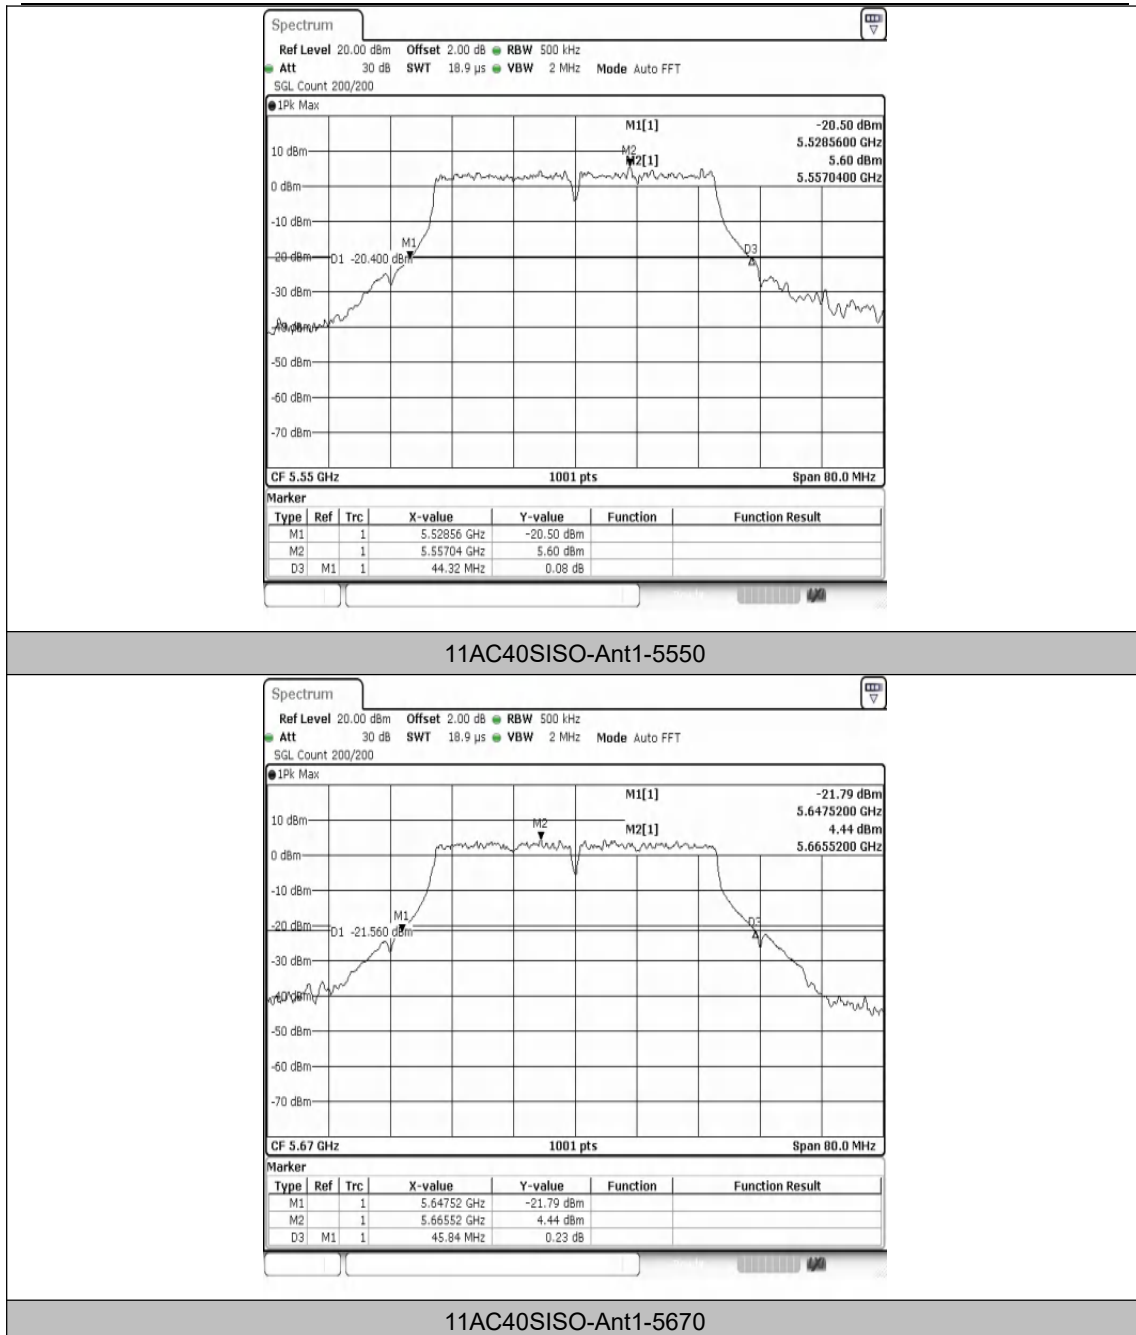

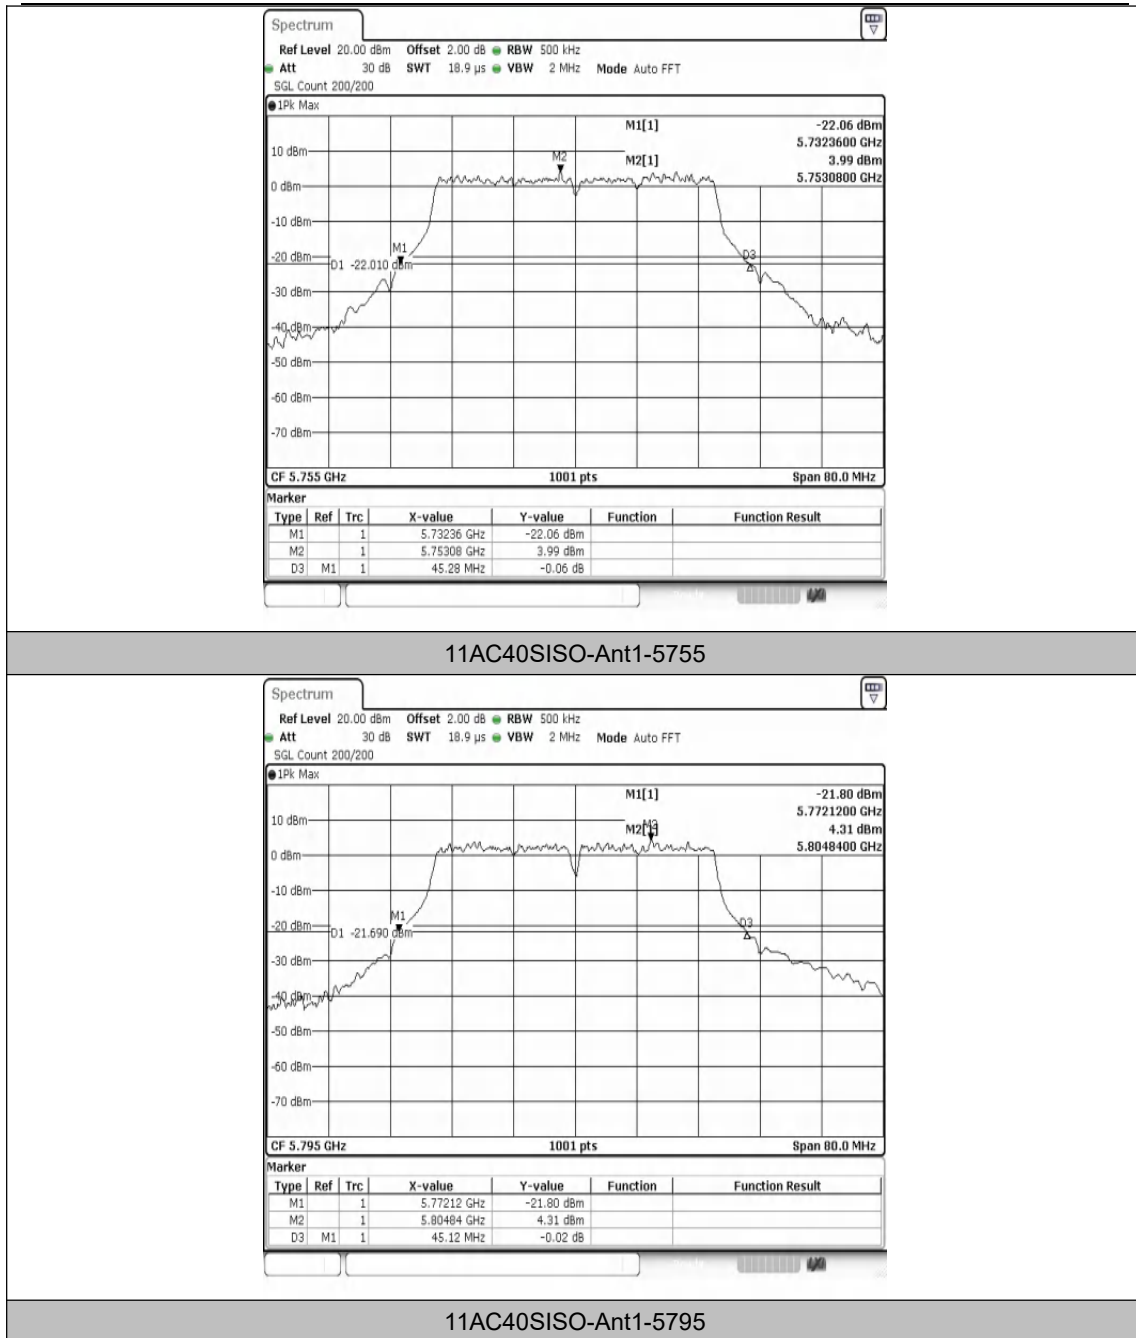

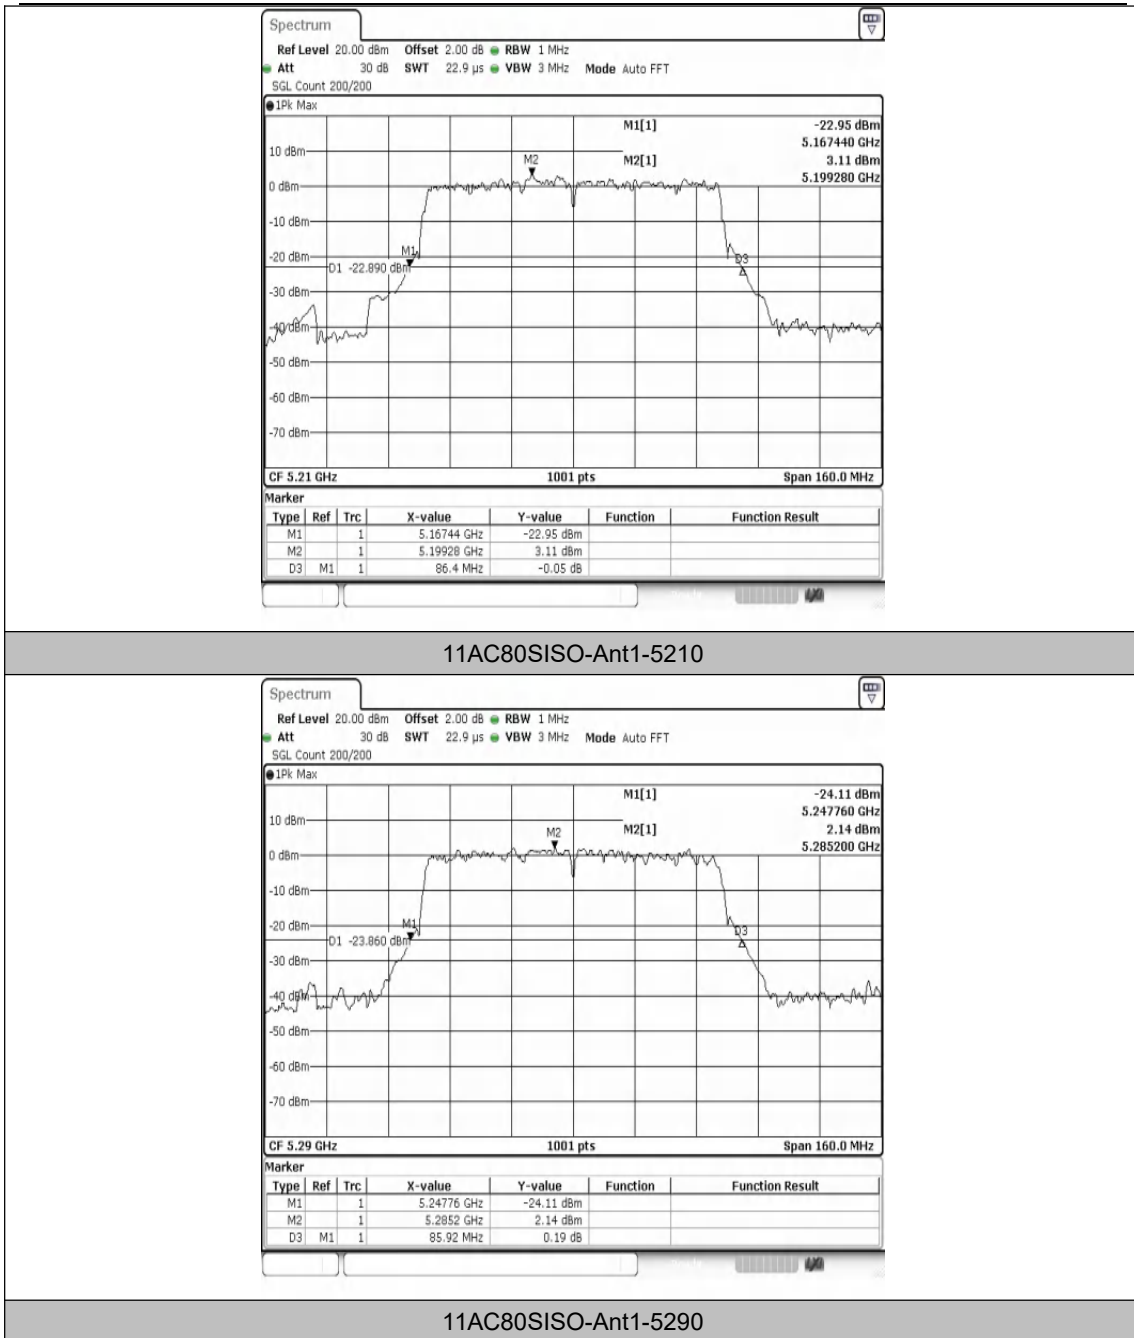

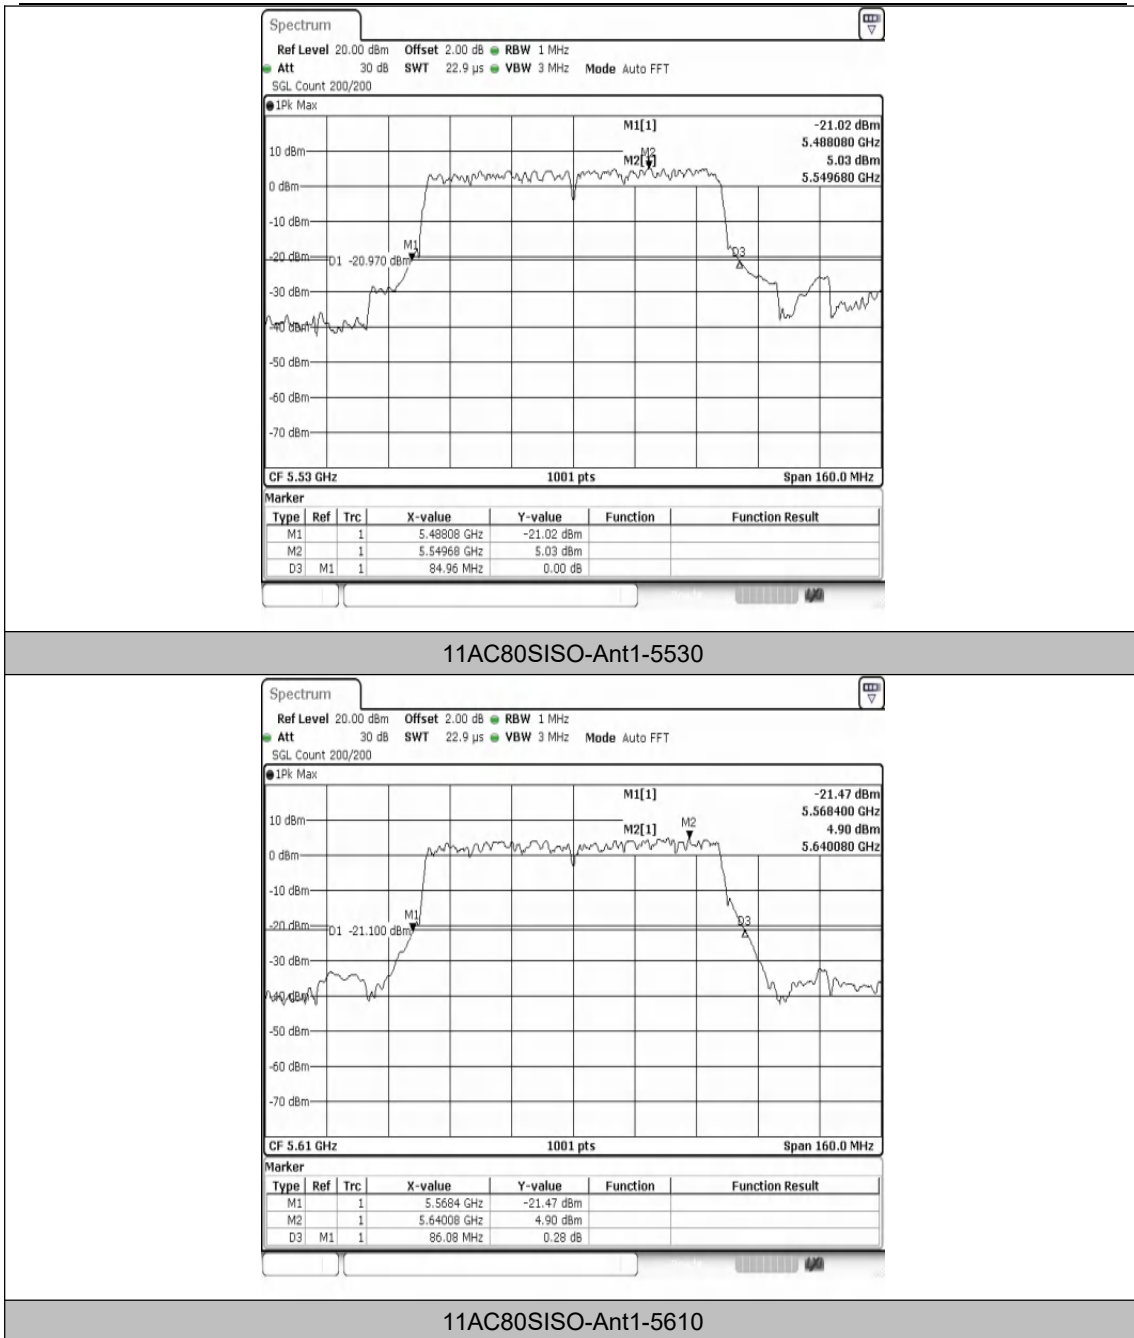


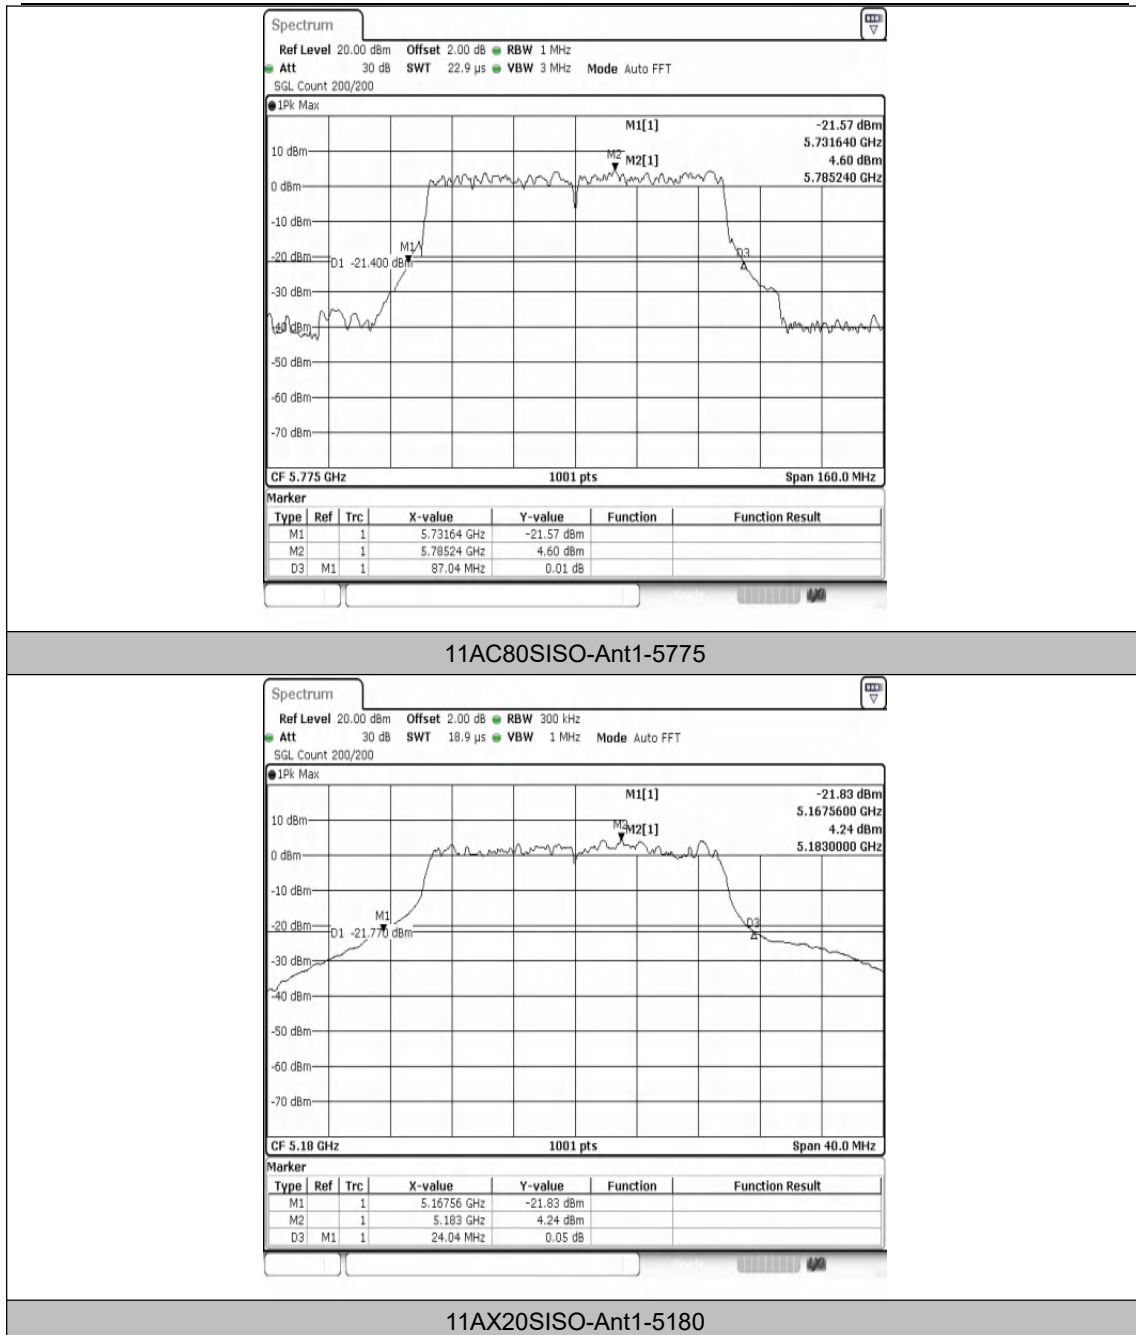



Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

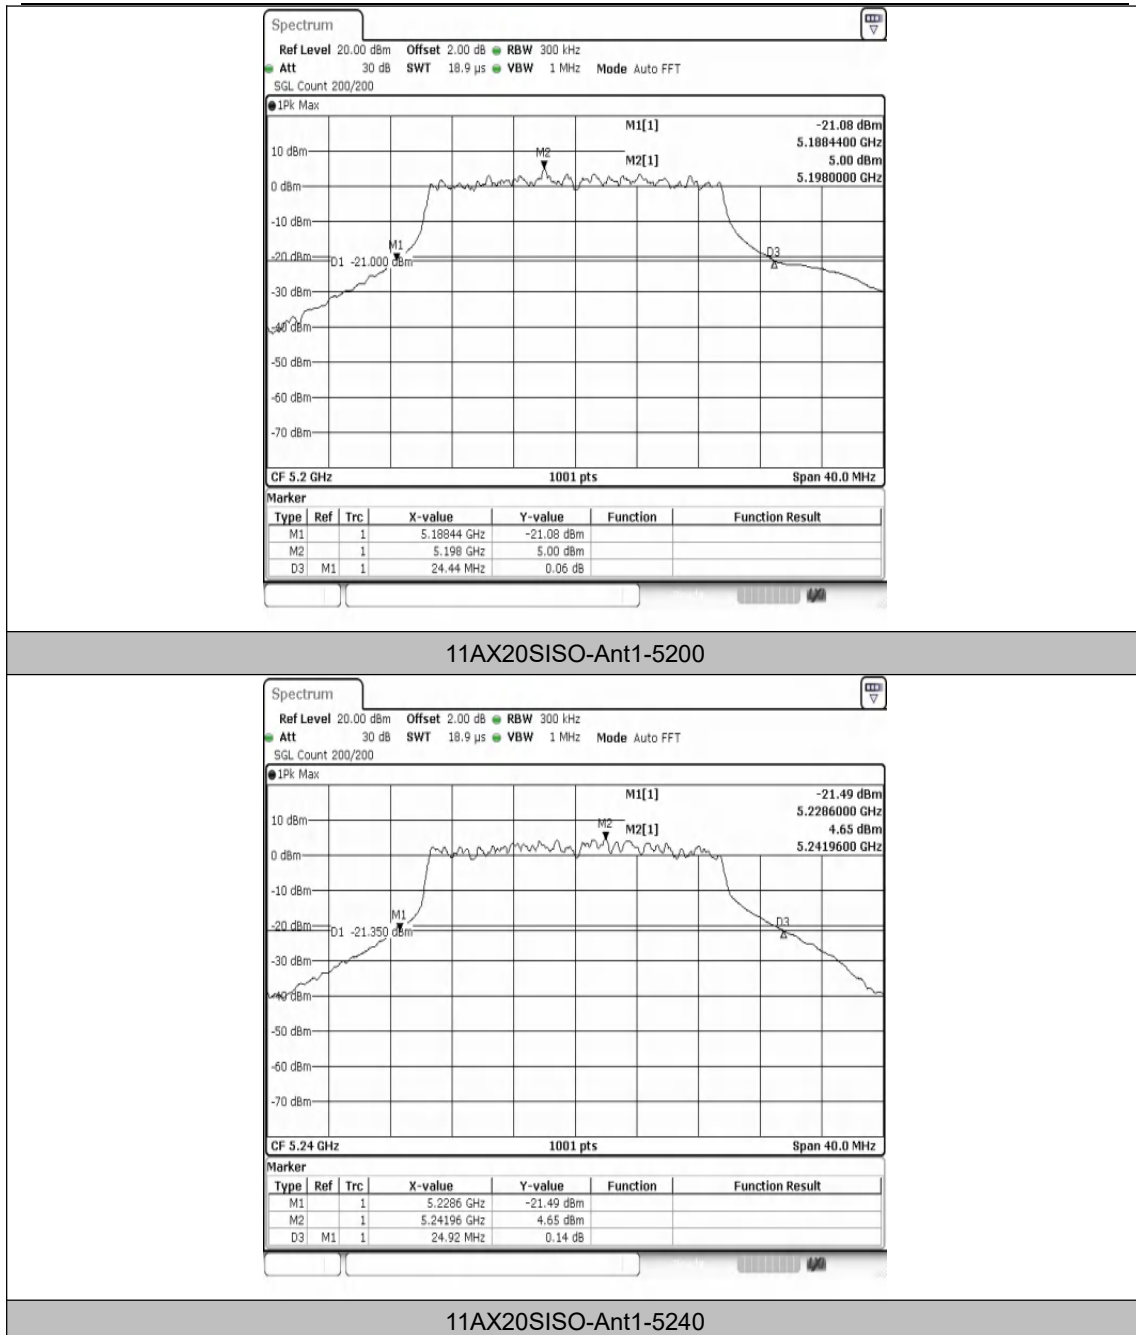


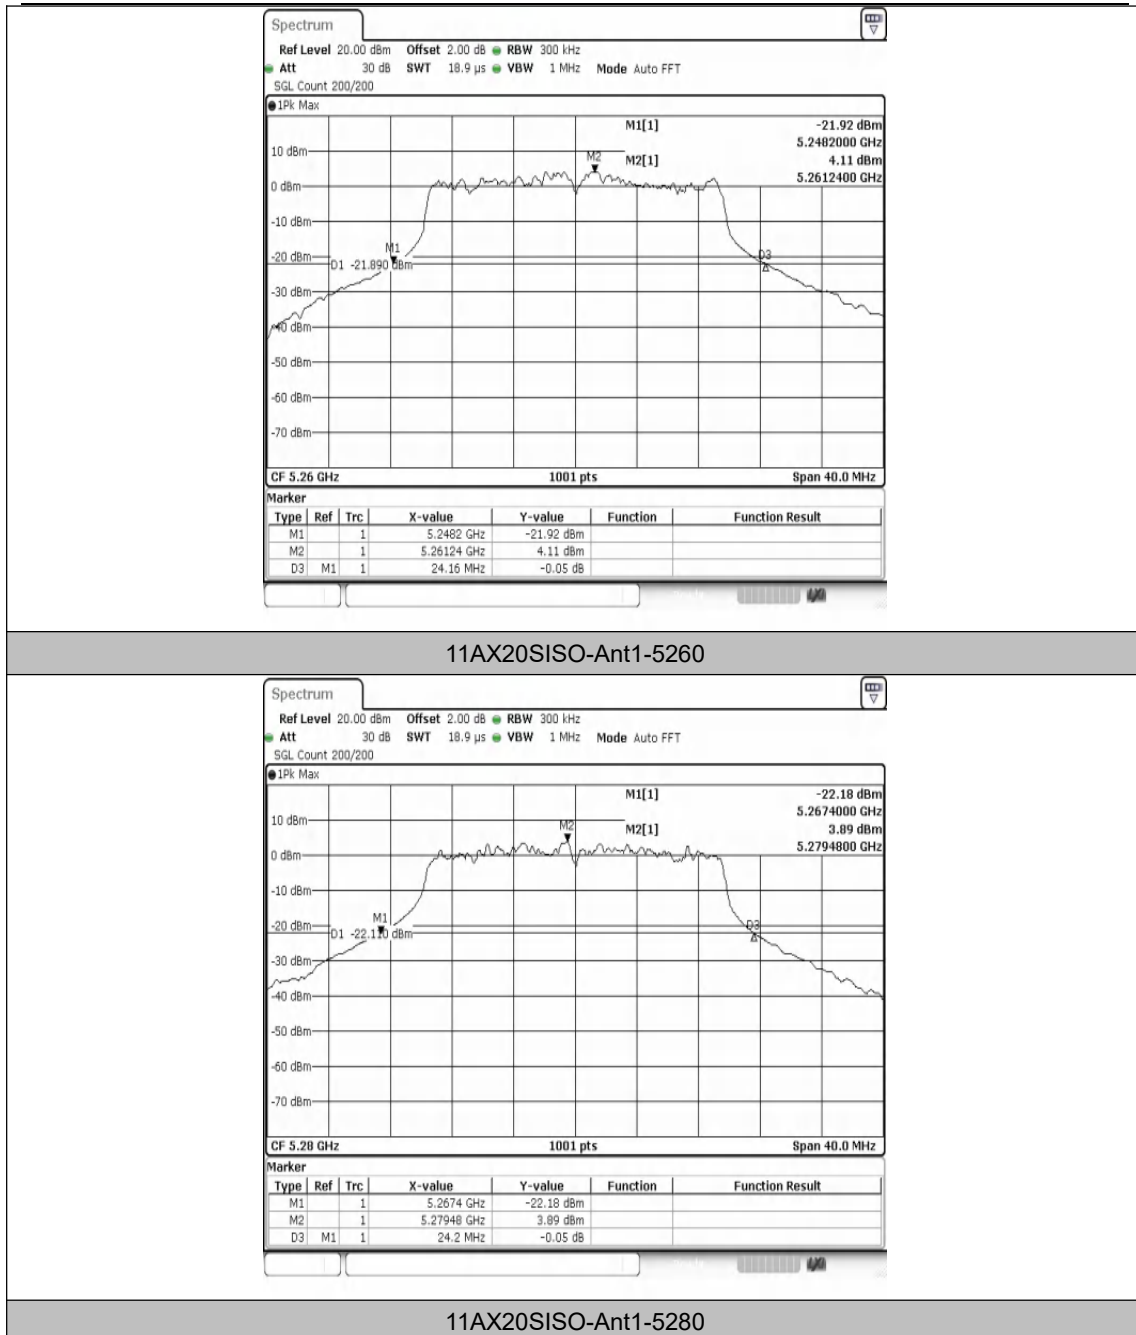


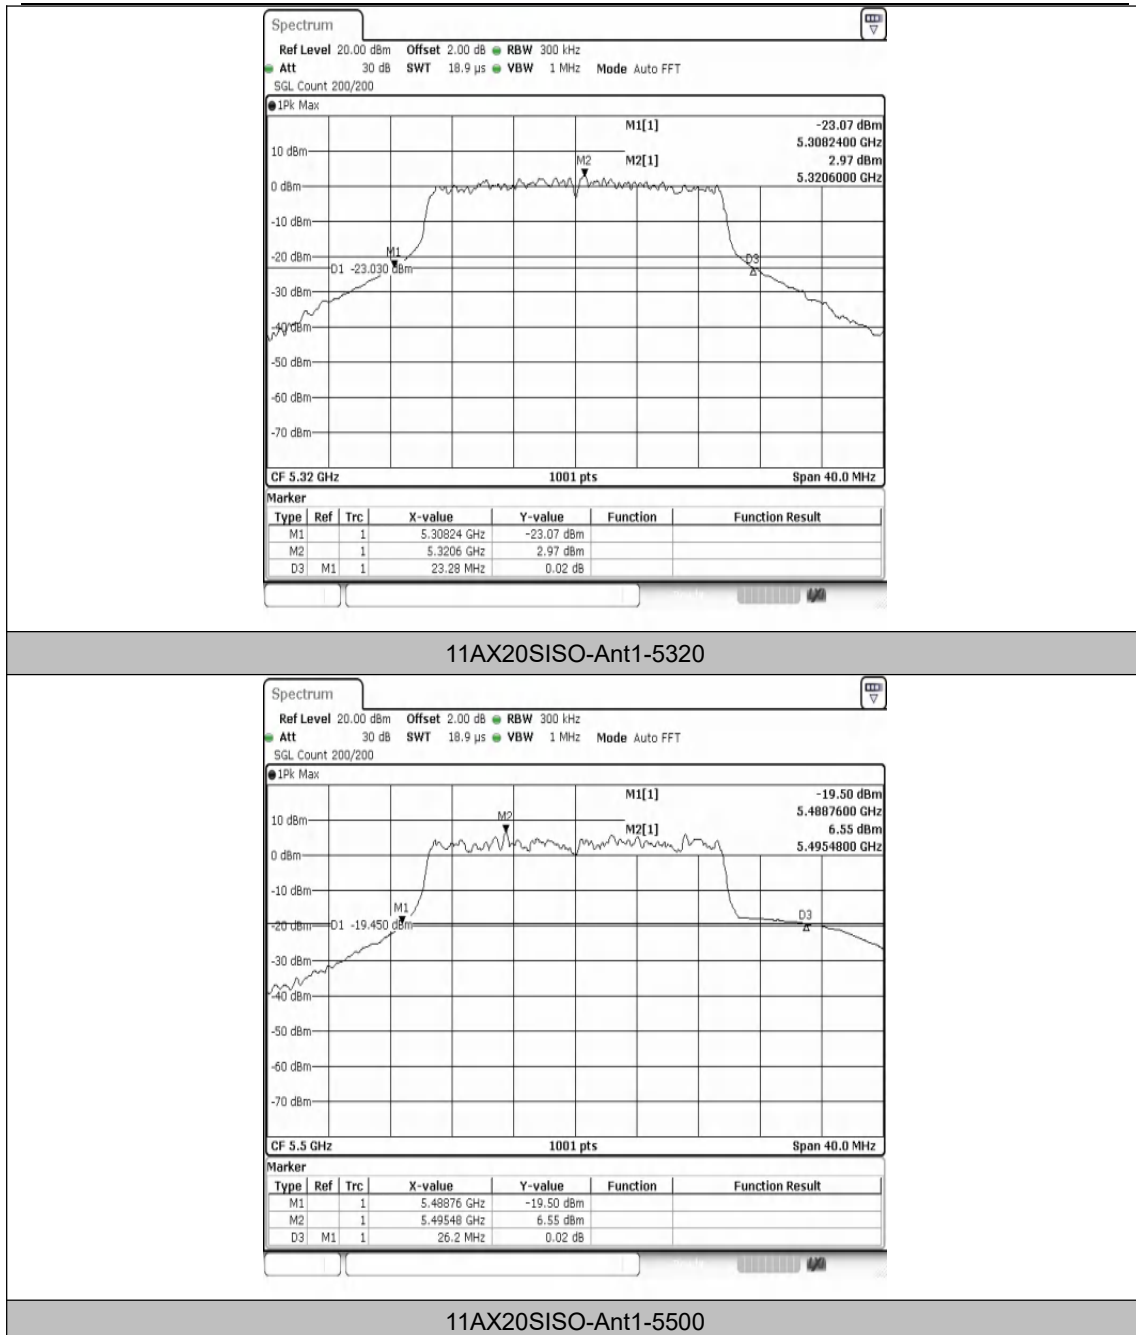


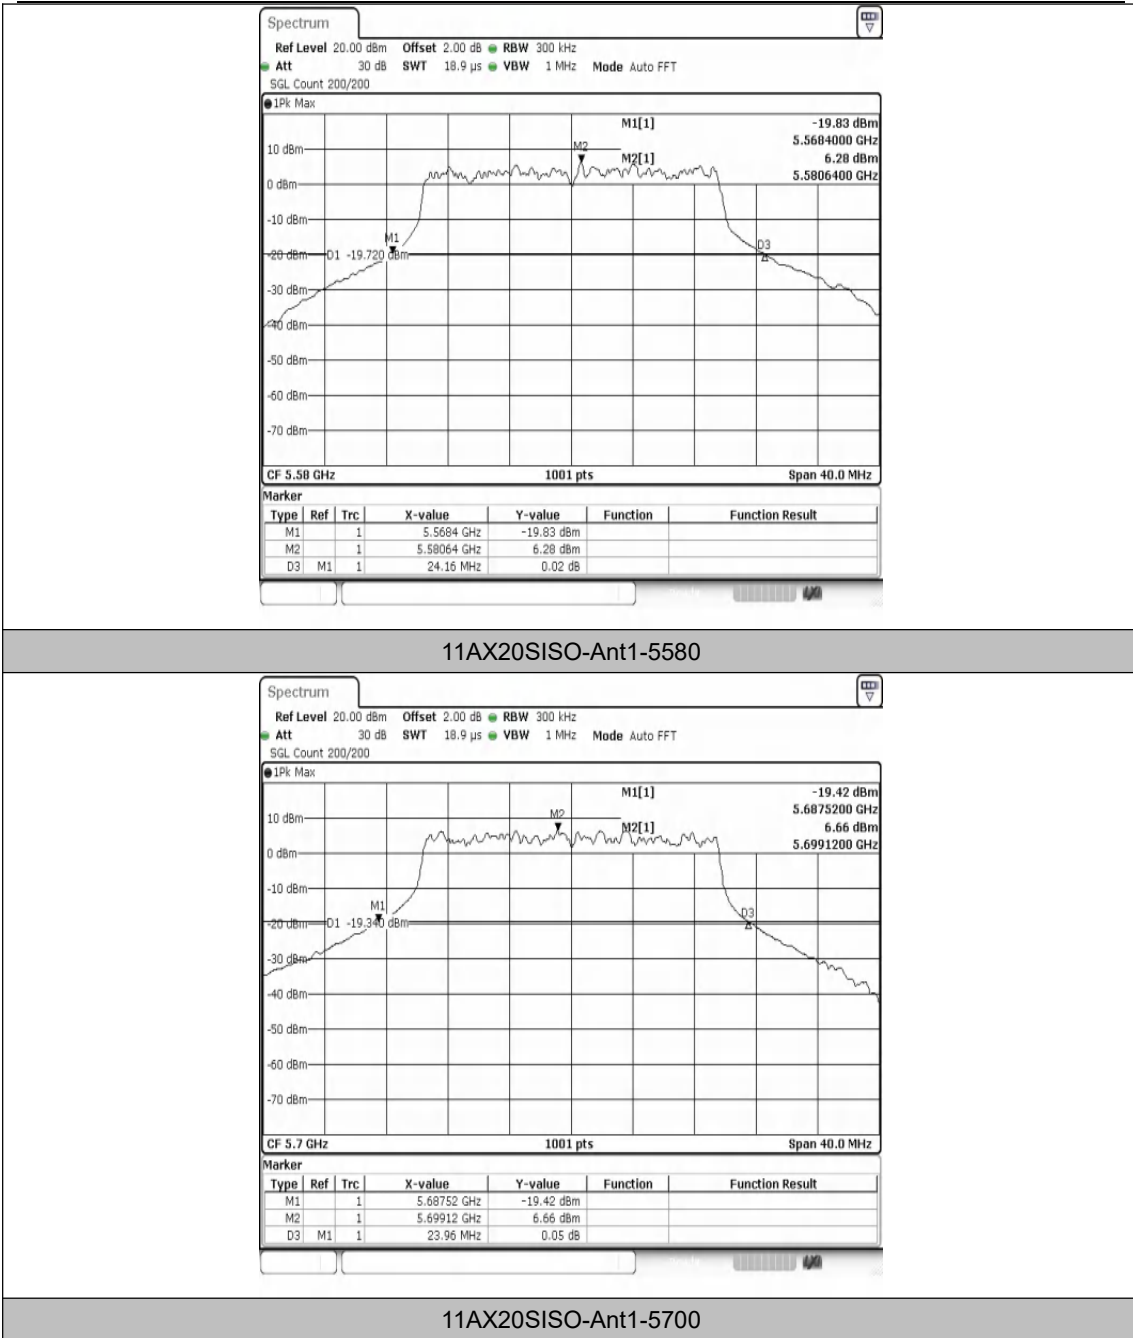


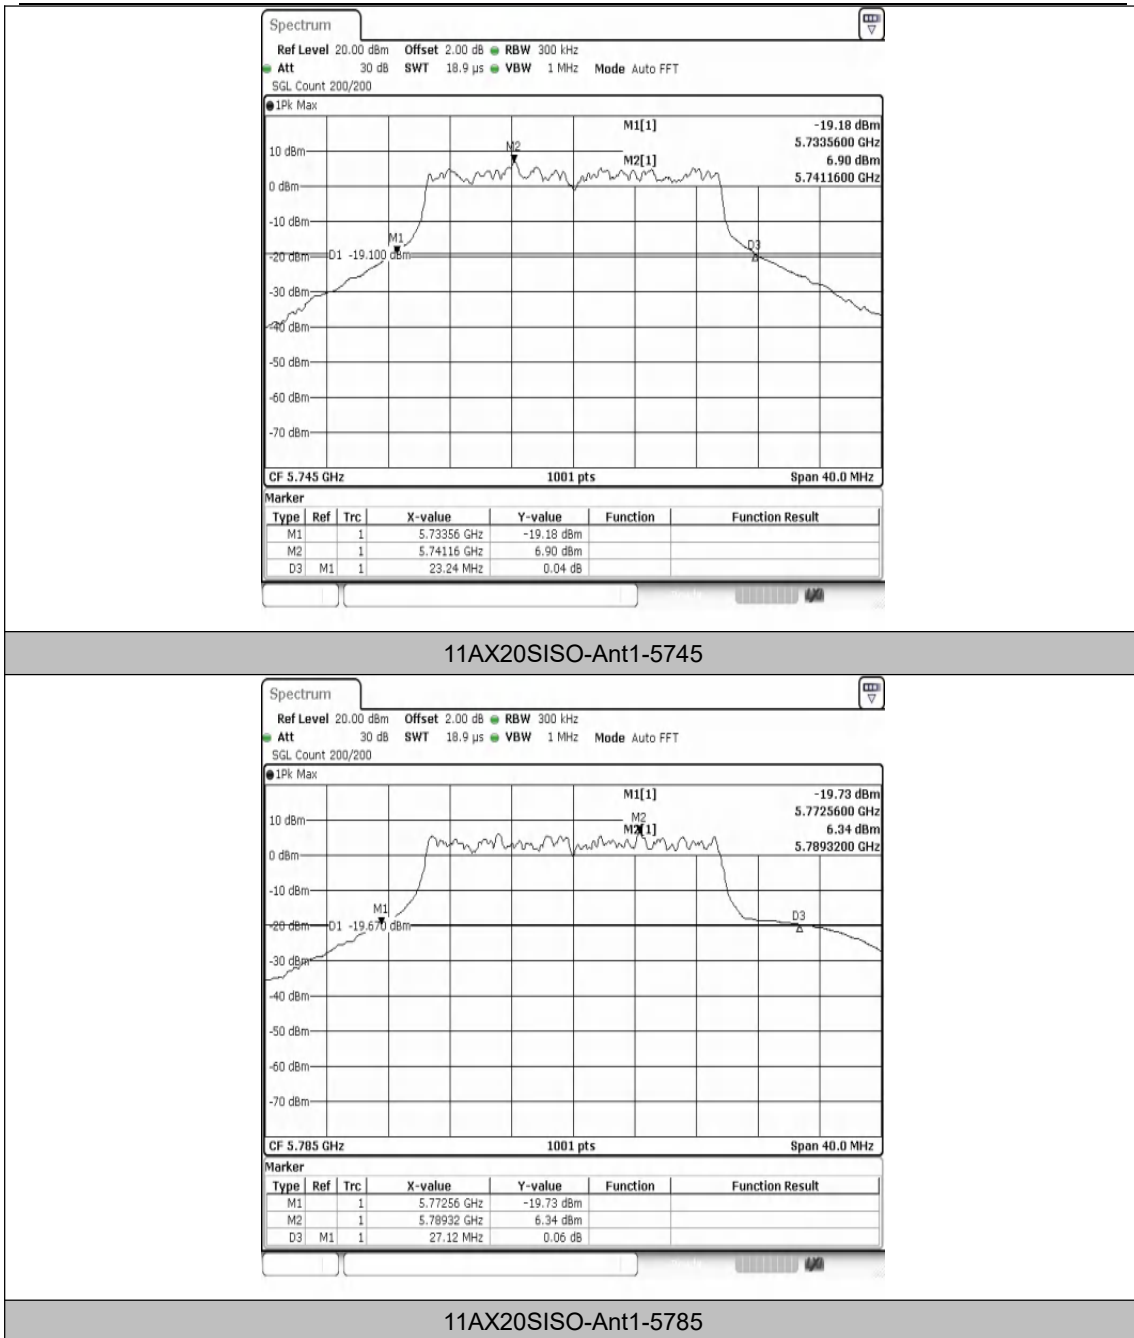

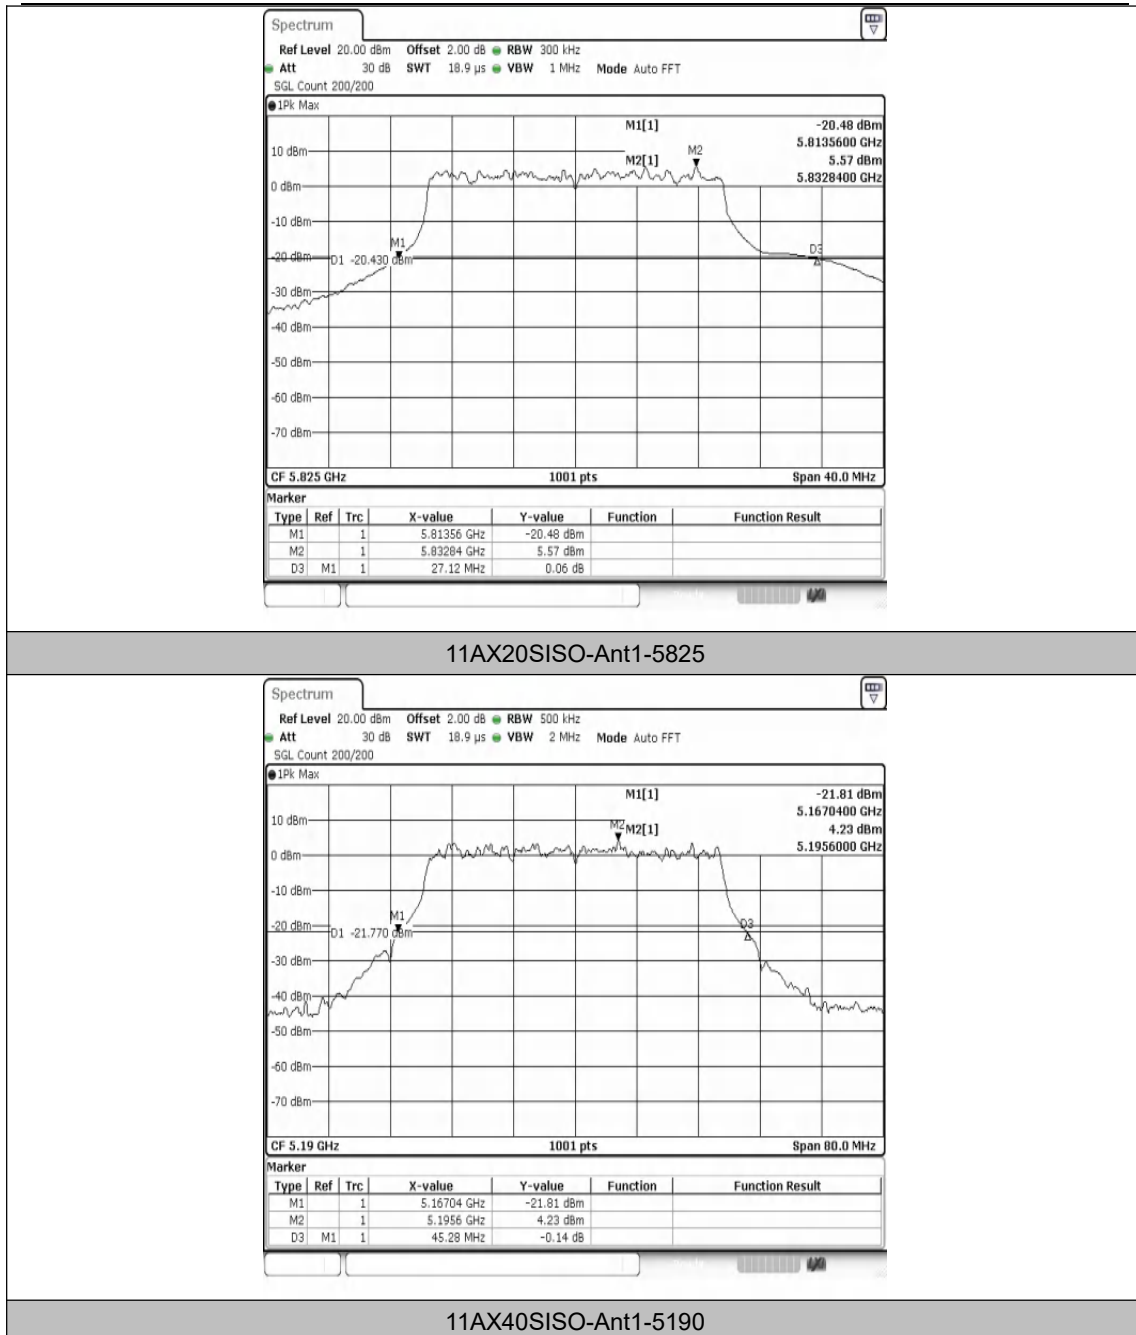

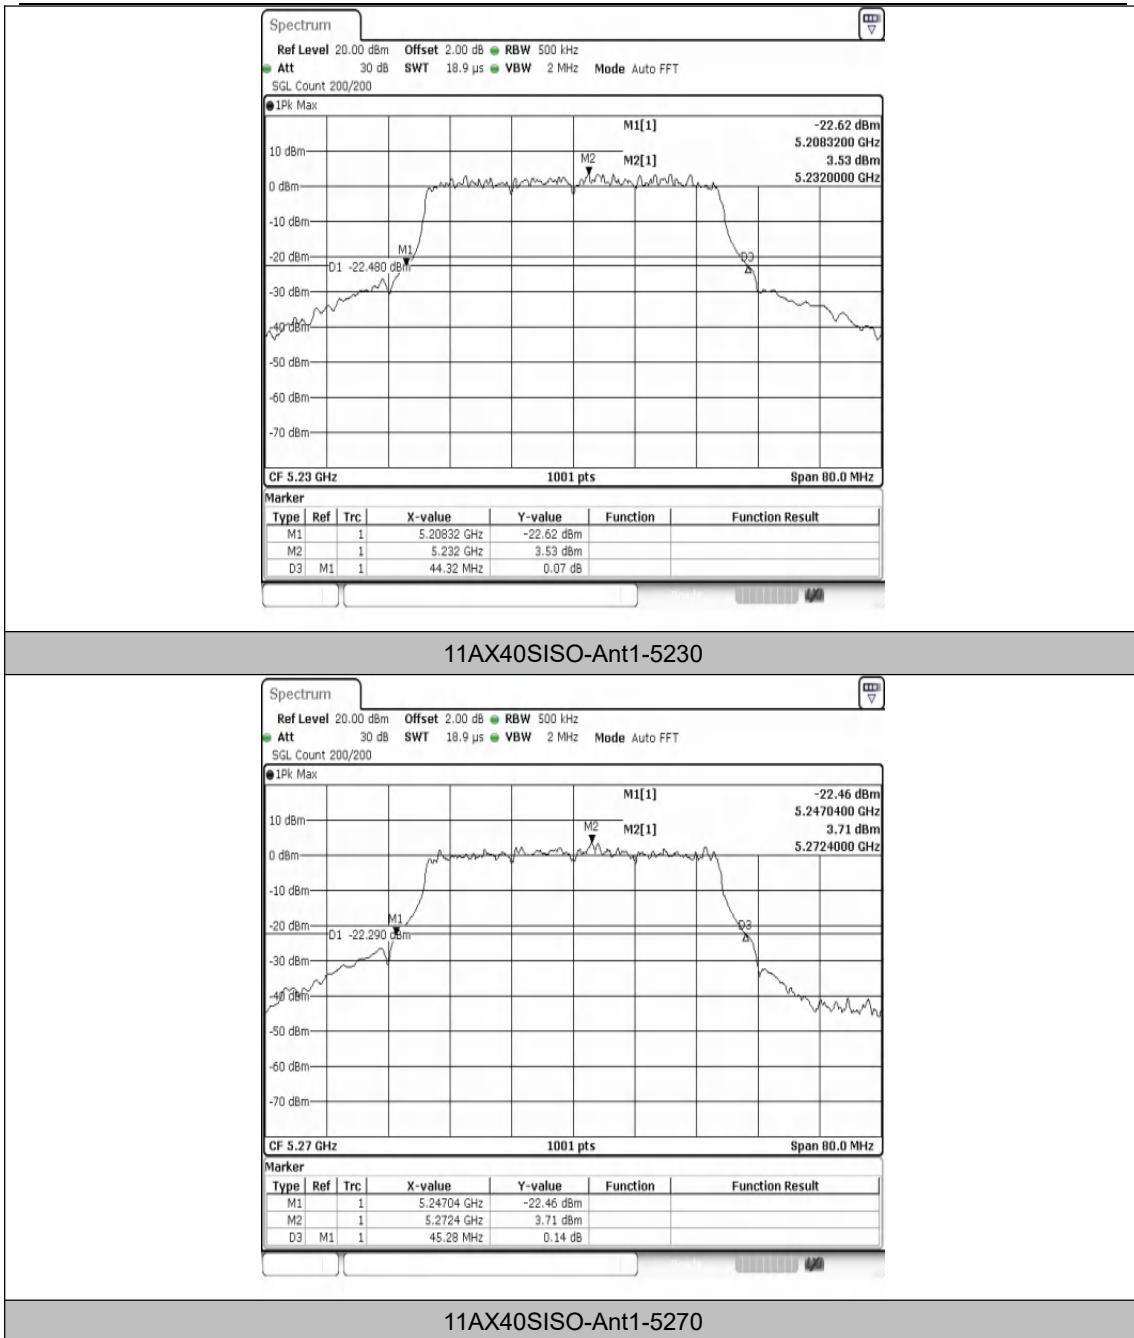

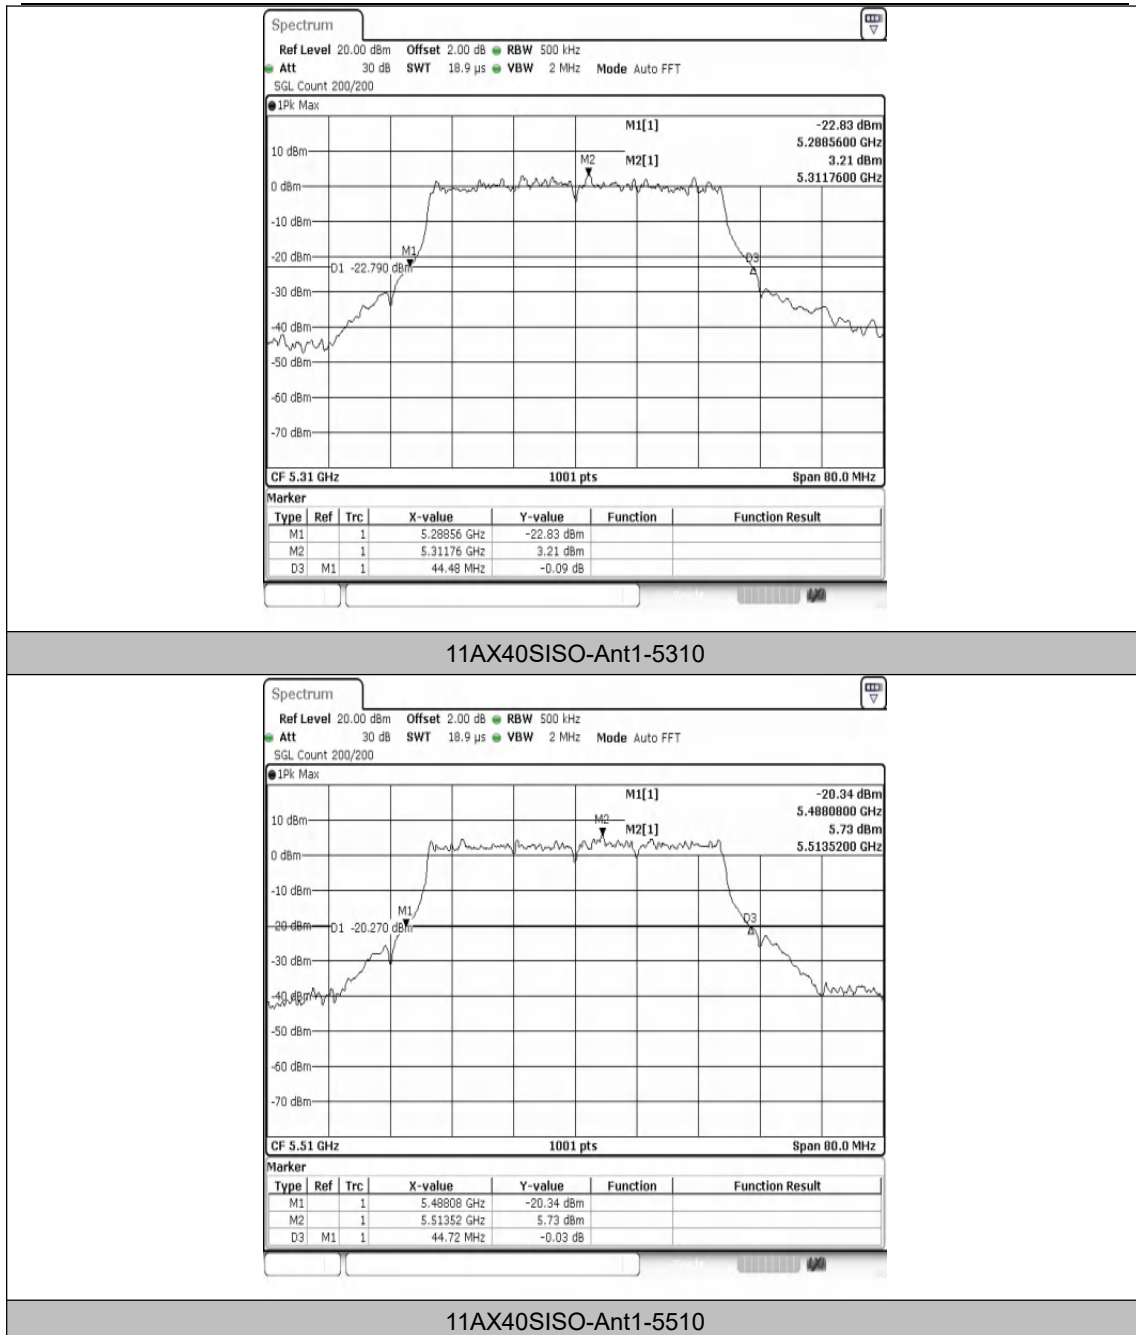


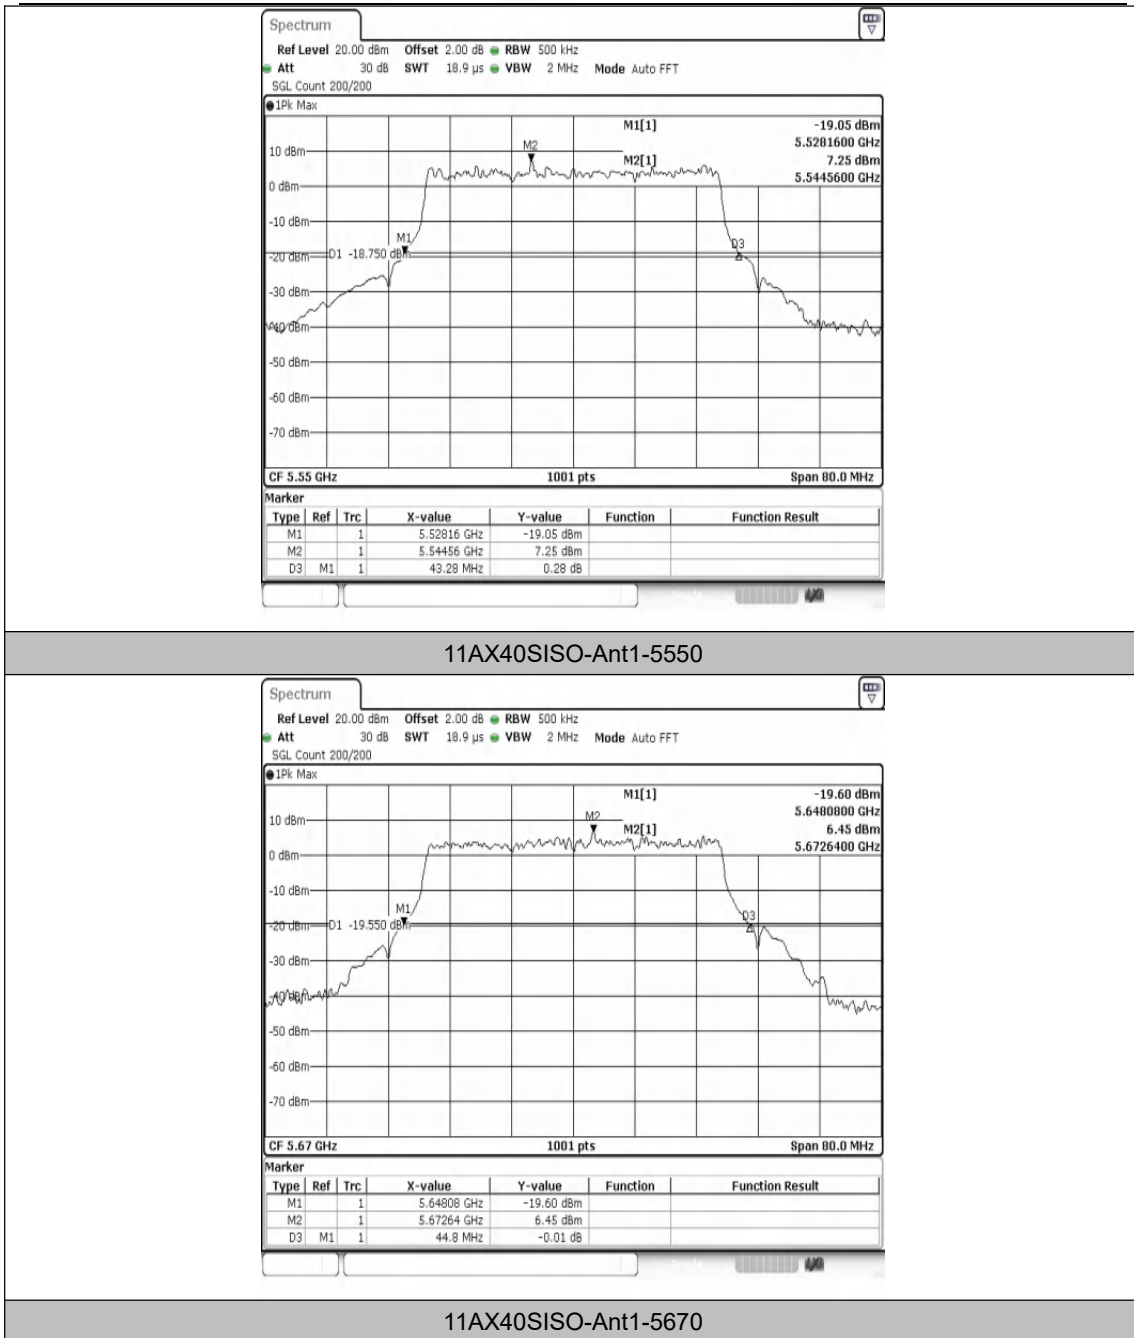

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

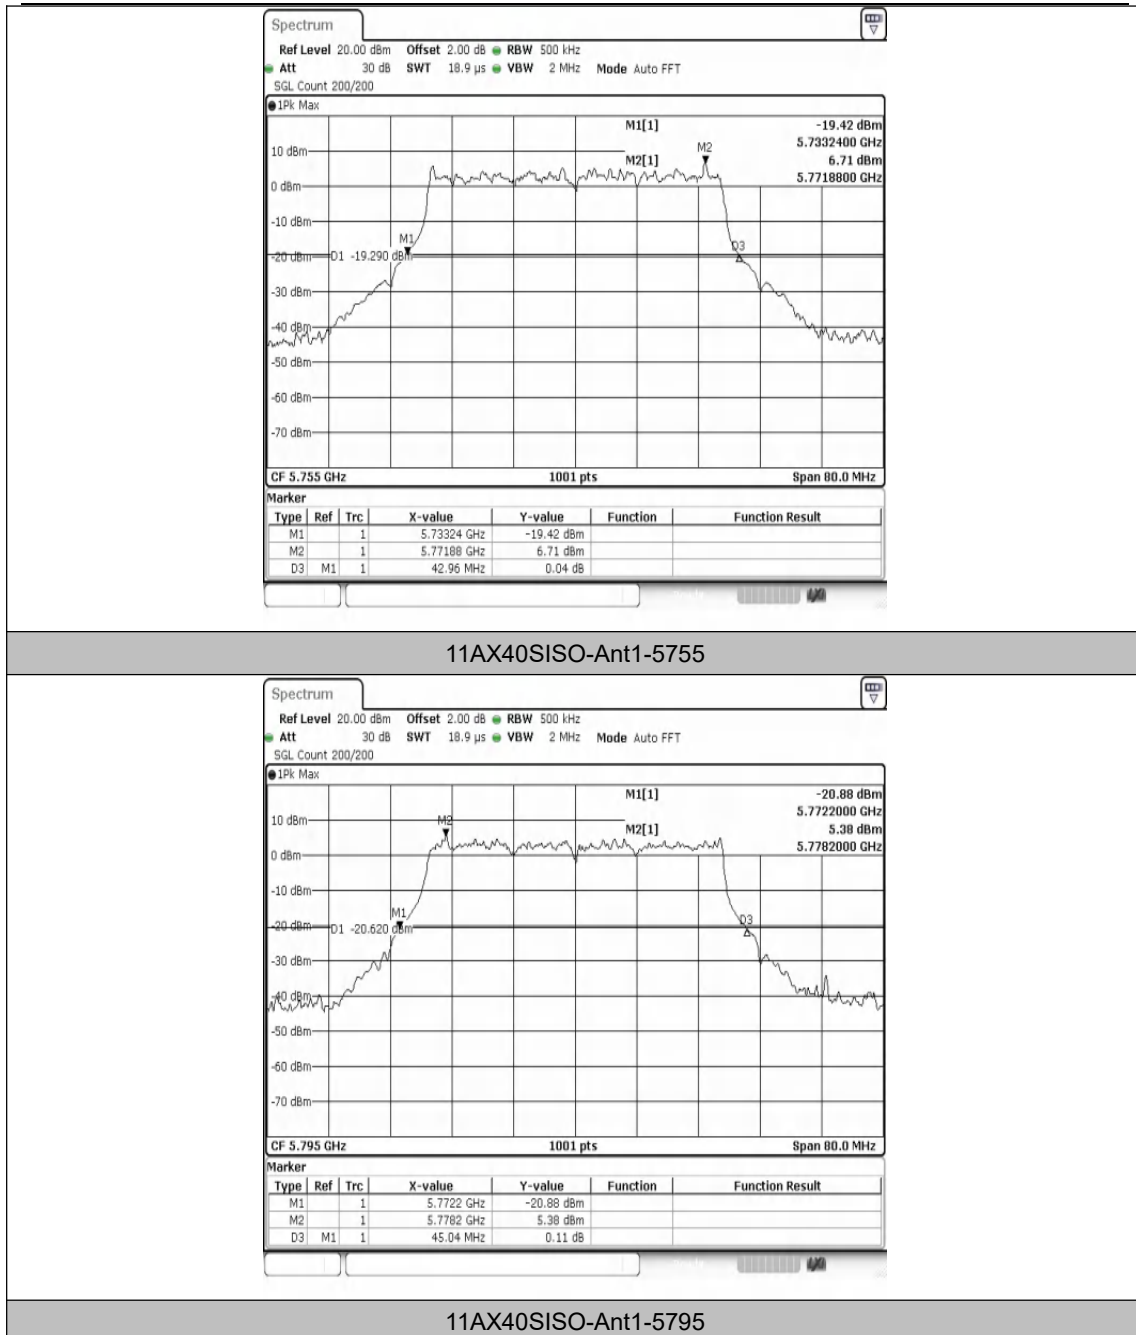


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

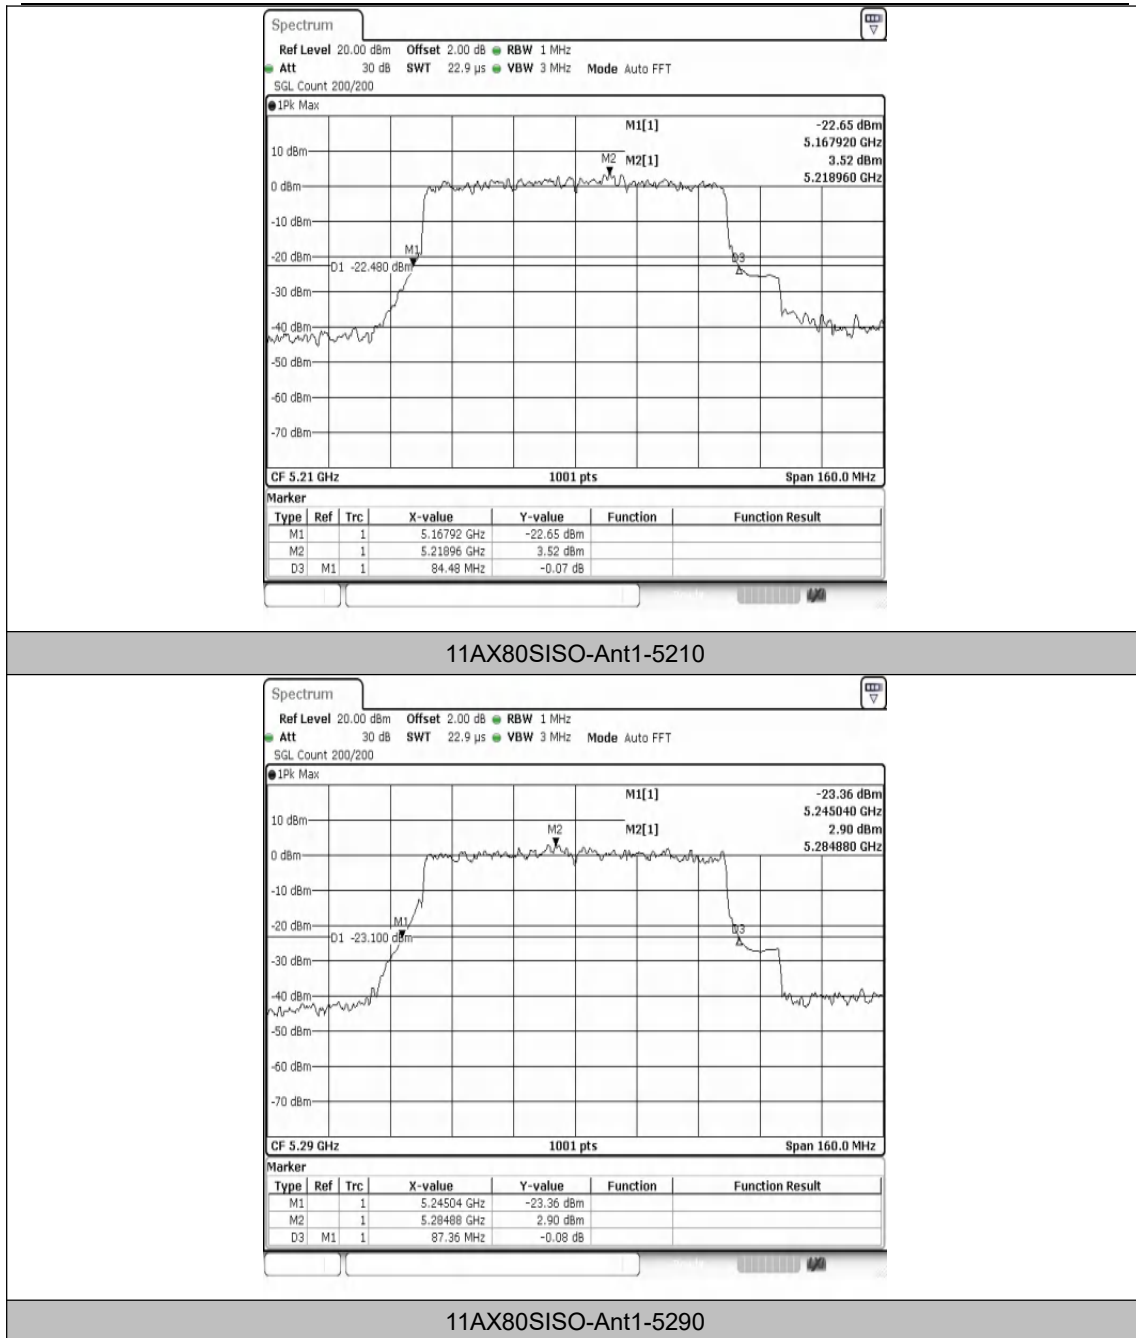

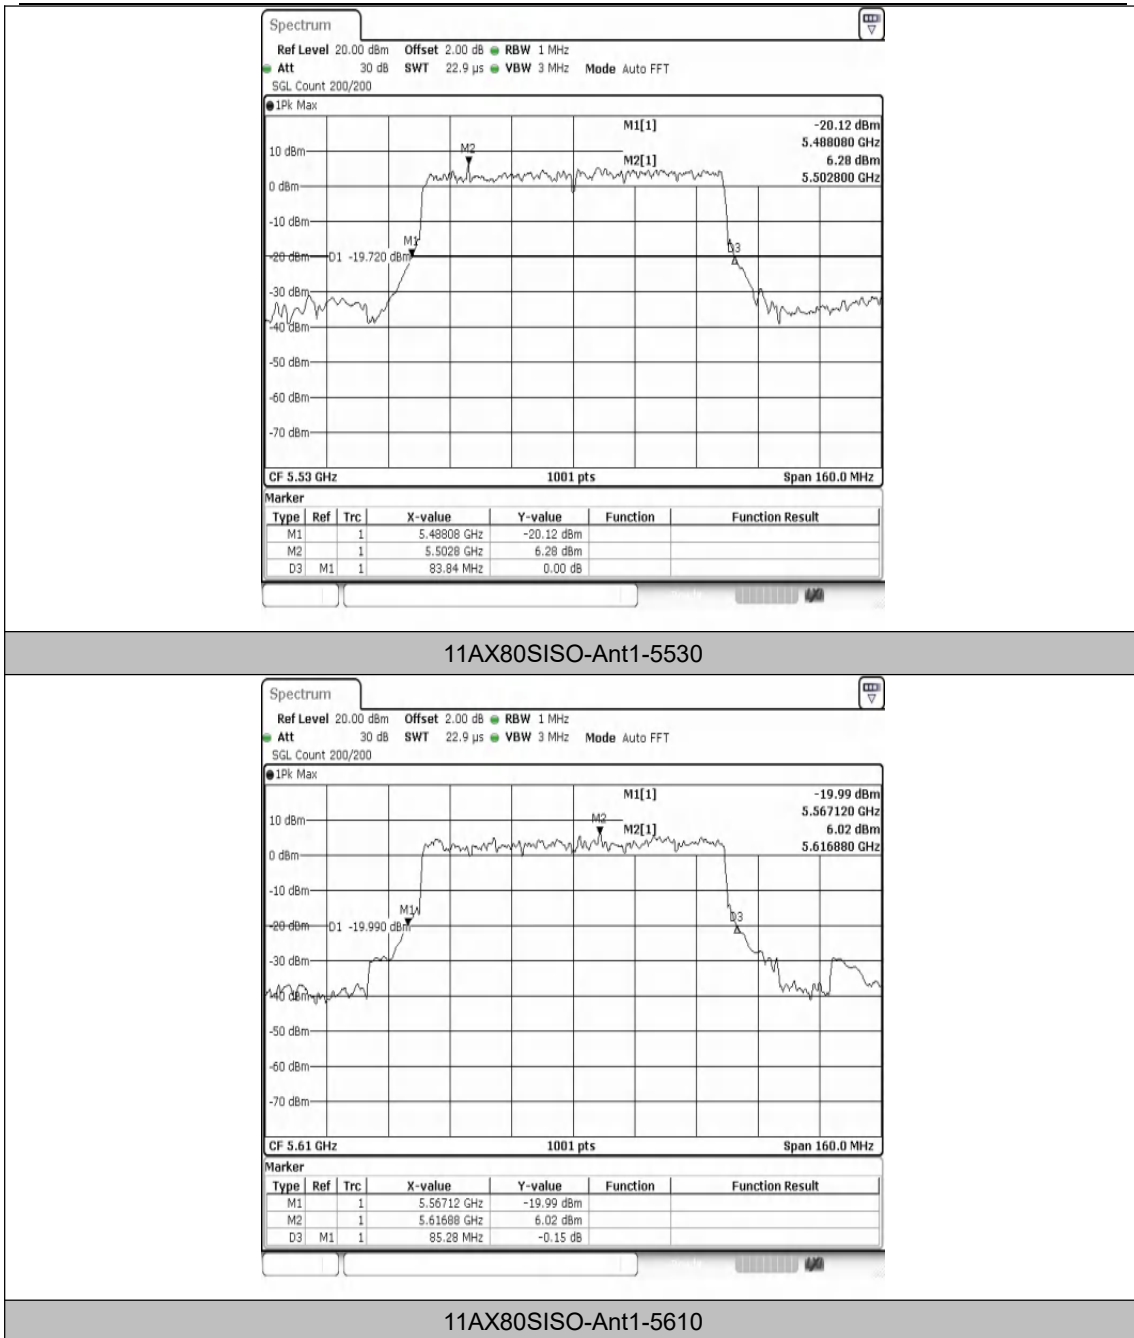



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix A2: 99% Occupied Bandwidth

Test Result

Test Mode	Antenna	Frequency[MHz]	OCB [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5180	17.702	5171.0889	5188.7912	---	---
11A	Ant1	5200	17.622	5191.2488	5208.8711	---	---
11A	Ant1	5240	17.542	5231.1289	5248.6713	---	---
11A	Ant1	5260	17.542	5251.0490	5268.5914	---	---
11A	Ant1	5280	17.742	5270.9690	5288.7113	---	---
11A	Ant1	5320	18.581	5310.4895	5329.0709	---	---
11A	Ant1	5500	17.822	5490.8092	5508.6314	---	---
11A	Ant1	5580	18.382	5571.2887	5589.6703	---	---
11A	Ant1	5700	17.982	5691.1688	5709.1508	---	---
11A	Ant1	5745	18.262	5736.0490	5754.3107	---	---
11A	Ant1	5785	18.302	5775.8492	5794.1508	---	---
11A	Ant1	5825	18.142	5815.6893	5833.8312	---	---
11N20SISO	Ant1	5180	18.861	5170.4895	5189.3506	---	---
11N20SISO	Ant1	5200	18.941	5190.6094	5209.5504	---	---
11N20SISO	Ant1	5240	18.581	5230.7293	5249.3107	---	---
11N20SISO	Ant1	5260	19.421	5249.8102	5269.2308	---	---
11N20SISO	Ant1	5280	18.342	5280.7592	5299.1009	---	---
11N20SISO	Ant1	5320	18.741	5310.5694	5329.3107	---	---
11N20SISO	Ant1	5500	19.580	5490.0899	5509.6703	---	---
11N20SISO	Ant1	5580	19.061	5570.6893	5589.7502	---	---
11N20SISO	Ant1	5700	18.581	5690.8092	5709.3906	---	---
11N20SISO	Ant1	5745	18.821	5735.5694	5754.3906	---	---
11N20SISO	Ant1	5785	19.900	5775.2498	5795.1499	---	---
11N20SISO	Ant1	5825	19.780	5814.5704	5834.3506	---	---
11N40SISO	Ant1	5190	37.163	5171.1389	5208.3017	---	---
11N40SISO	Ant1	5230	36.763	5211.5385	5248.3017	---	---
11N40SISO	Ant1	5270	36.923	5251.4585	5288.3816	---	---
11N40SISO	Ant1	5310	37.323	5291.4585	5328.7812	---	---
11N40SISO	Ant1	5510	37.722	5491.2188	5528.9411	---	---
11N40SISO	Ant1	5550	37.403	5531.4585	5568.8611	---	---
11N40SISO	Ant1	5670	37.403	5651.2188	5688.6214	---	---
11N40SISO	Ant1	5755	37.003	5736.6983	5773.7013	---	---
11N40SISO	Ant1	5795	37.003	5776.5385	5813.5415	---	---
11AC20SISO	Ant1	5180	18.941	5170.6494	5189.5904	---	---
11AC20SISO	Ant1	5200	18.741	5190.5694	5209.3107	---	---
11AC20SISO	Ant1	5240	18.981	5230.4895	5249.4705	---	---
11AC20SISO	Ant1	5260	18.941	5250.6094	5269.5504	---	---

11AC20SISO	Ant1	5280	18.661	5270.5295	5289.1908	---	---
11AC20SISO	Ant1	5320	18.981	5310.4895	5329.4705	---	---
11AC20SISO	Ant1	5500	19.620	5490.1698	5509.7902	---	---
11AC20SISO	Ant1	5580	18.901	5570.6494	5589.5504	---	---
11AC20SISO	Ant1	5700	18.701	5690.7692	5709.4705	---	---
11AC20SISO	Ant1	5745	18.901	5735.5295	5754.4306	---	---
11AC20SISO	Ant1	5785	19.301	5775.3297	5794.6304	---	---
11AC20SISO	Ant1	5825	18.821	5815.5295	5834.3506	---	---
11AC40SISO	Ant1	5190	36.763	5171.7782	5208.5415	---	---
11AC40SISO	Ant1	5230	36.843	5211.6184	5248.4615	---	---
11AC40SISO	Ant1	5270	37.163	5251.5385	5288.7013	---	---
11AC40SISO	Ant1	5310	37.642	5291.2987	5328.9411	---	---
11AC40SISO	Ant1	5510	38.202	5491.1389	5529.3407	---	---
11AC40SISO	Ant1	5550	37.403	5531.3786	5568.7812	---	---
11AC40SISO	Ant1	5670	37.403	5651.1389	5688.5415	---	---
11AC40SISO	Ant1	5755	37.562	5736.3786	5773.9411	---	---
11AC40SISO	Ant1	5795	38.042	5776.0589	5814.1009	---	---
11AC80SISO	Ant1	5210	76.563	5171.6384	5248.2018	---	---
11AC80SISO	Ant1	5290	77.203	5250.9990	5328.2018	---	---
11AC80SISO	Ant1	5530	76.723	5491.9580	5568.6813	---	---
11AC80SISO	Ant1	5610	76.723	5571.9580	5648.6813	---	---
11AC80SISO	Ant1	5775	76.883	5736.7982	5813.6813	---	---
11AX20SISO	Ant1	5180	19.700	5170.1299	5189.8302	---	---
11AX20SISO	Ant1	5200	19.341	5190.3696	5209.7103	---	---
11AX20SISO	Ant1	5240	19.421	5230.3696	5249.7902	---	---
11AX20SISO	Ant1	5260	19.381	5250.3297	5269.7103	---	---
11AX20SISO	Ant1	5280	19.421	5270.3696	5289.7902	---	---
11AX20SISO	Ant1	5320	19.580	5310.2498	5329.8302	---	---
11AX20SISO	Ant1	5500	19.421	5490.3297	5509.7502	---	---
11AX20SISO	Ant1	5580	19.860	5570.0100	5589.8701	---	---
11AX20SISO	Ant1	5700	19.500	5690.3297	5709.8302	---	---
11AX20SISO	Ant1	5745	20.100	5735.2098	5755.3097	---	---
11AX20SISO	Ant1	5785	19.820	5775.0899	5794.9101	---	---
11AX20SISO	Ant1	5825	19.500	5815.1698	5834.6703	---	---
11AX40SISO	Ant1	5190	38.042	5170.9790	5209.0210	---	---
11AX40SISO	Ant1	5230	38.202	5210.9790	5249.1808	---	---
11AX40SISO	Ant1	5270	38.202	5250.9790	5289.1808	---	---
11AX40SISO	Ant1	5310	38.202	5290.8192	5329.0210	---	---
11AX40SISO	Ant1	5510	38.761	5490.8192	5529.5804	---	---
11AX40SISO	Ant1	5550	38.442	5530.7393	5569.1808	---	---
11AX40SISO	Ant1	5670	38.841	5650.4995	5689.3407	---	---
11AX40SISO	Ant1	5755	38.841	5735.5794	5774.4206	---	---


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

11AX40SISO	Ant1	5795	38.442	5775.7393	5814.1808	---	---
11AX80SISO	Ant1	5210	77.842	5171.1588	5249.0010	---	---
11AX80SISO	Ant1	5290	77.522	5250.9990	5328.5215	---	---
11AX80SISO	Ant1	5530	78.322	5490.9990	5569.3207	---	---
11AX80SISO	Ant1	5610	78.162	5571.1588	5649.3207	---	---
11AX80SISO	Ant1	5775	78.322	5735.8392	5814.1608	---	---


Test Graphs

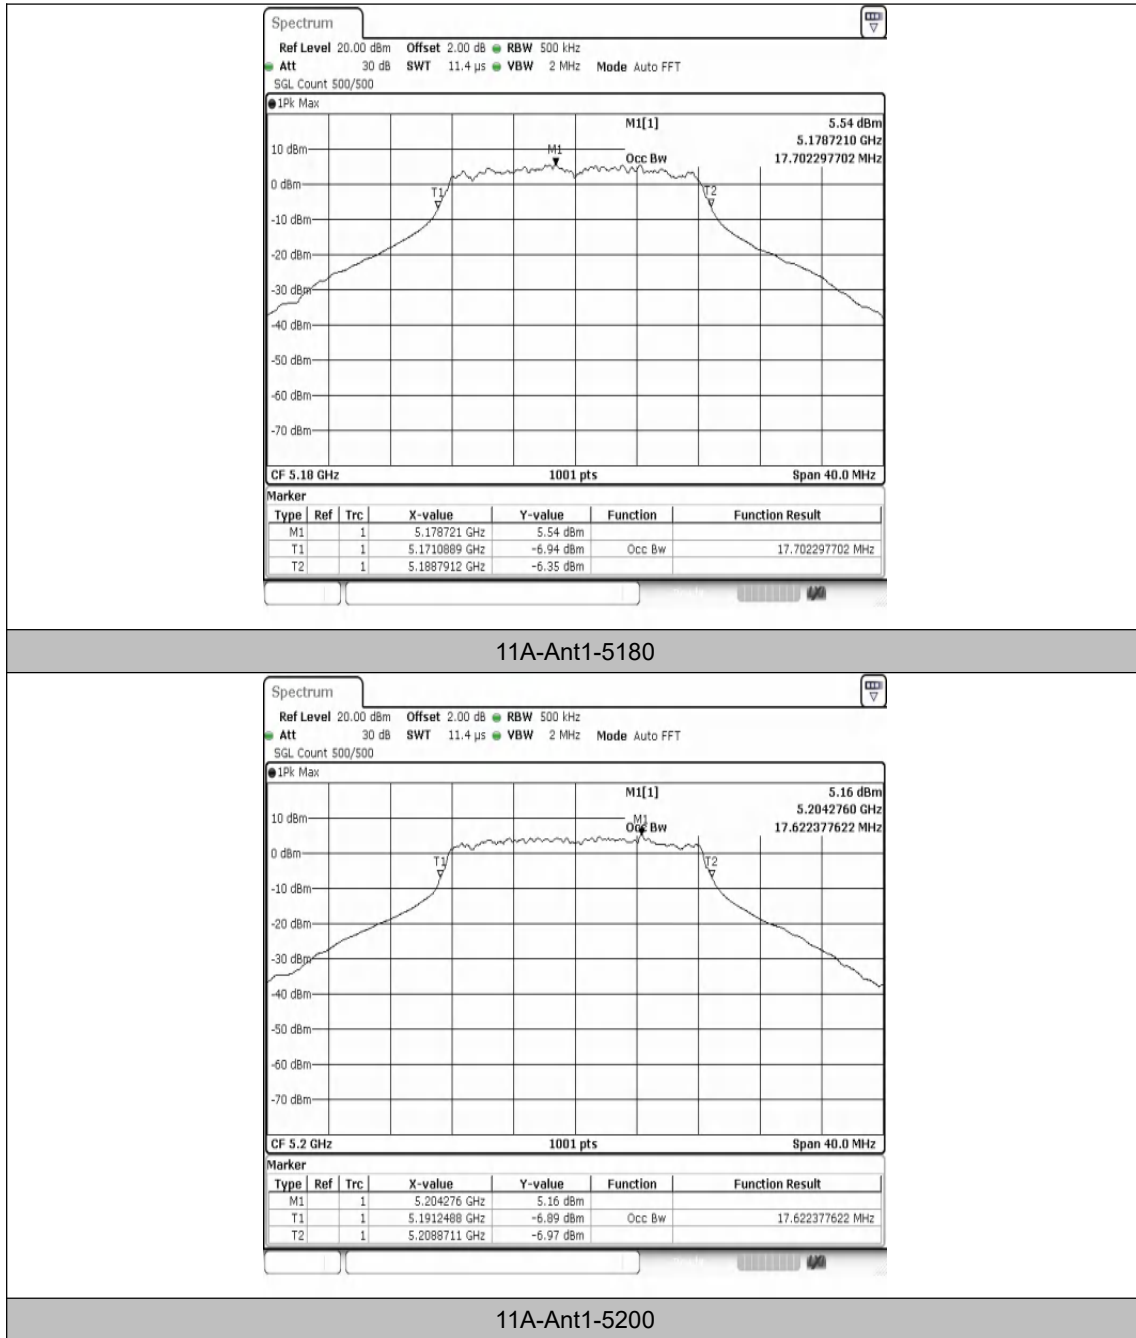



Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

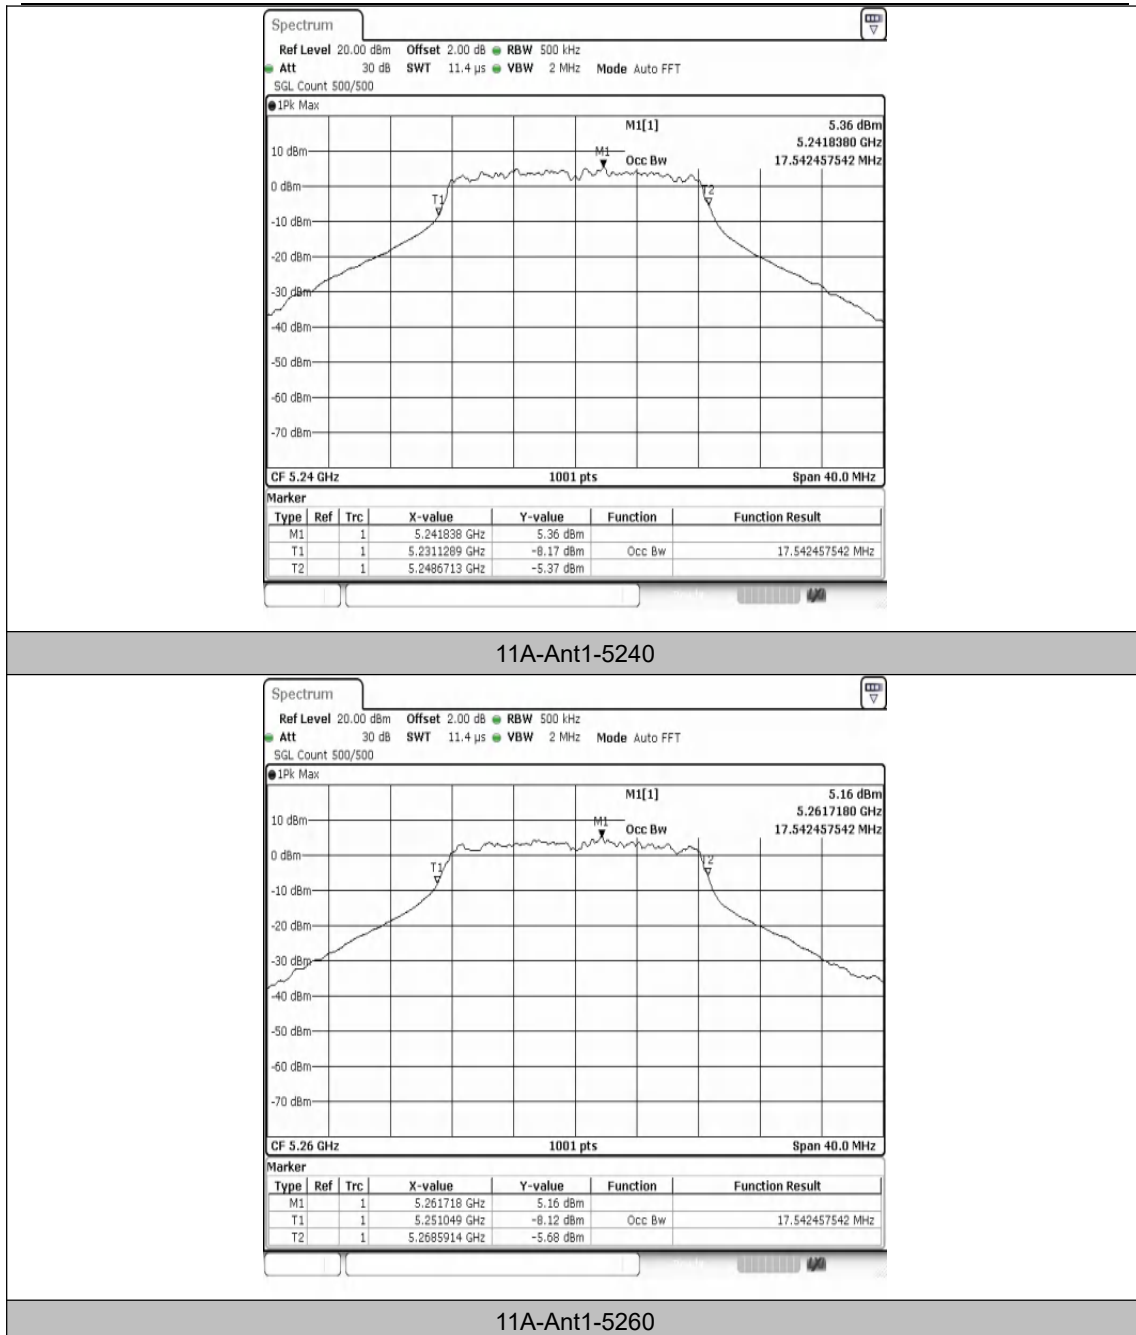


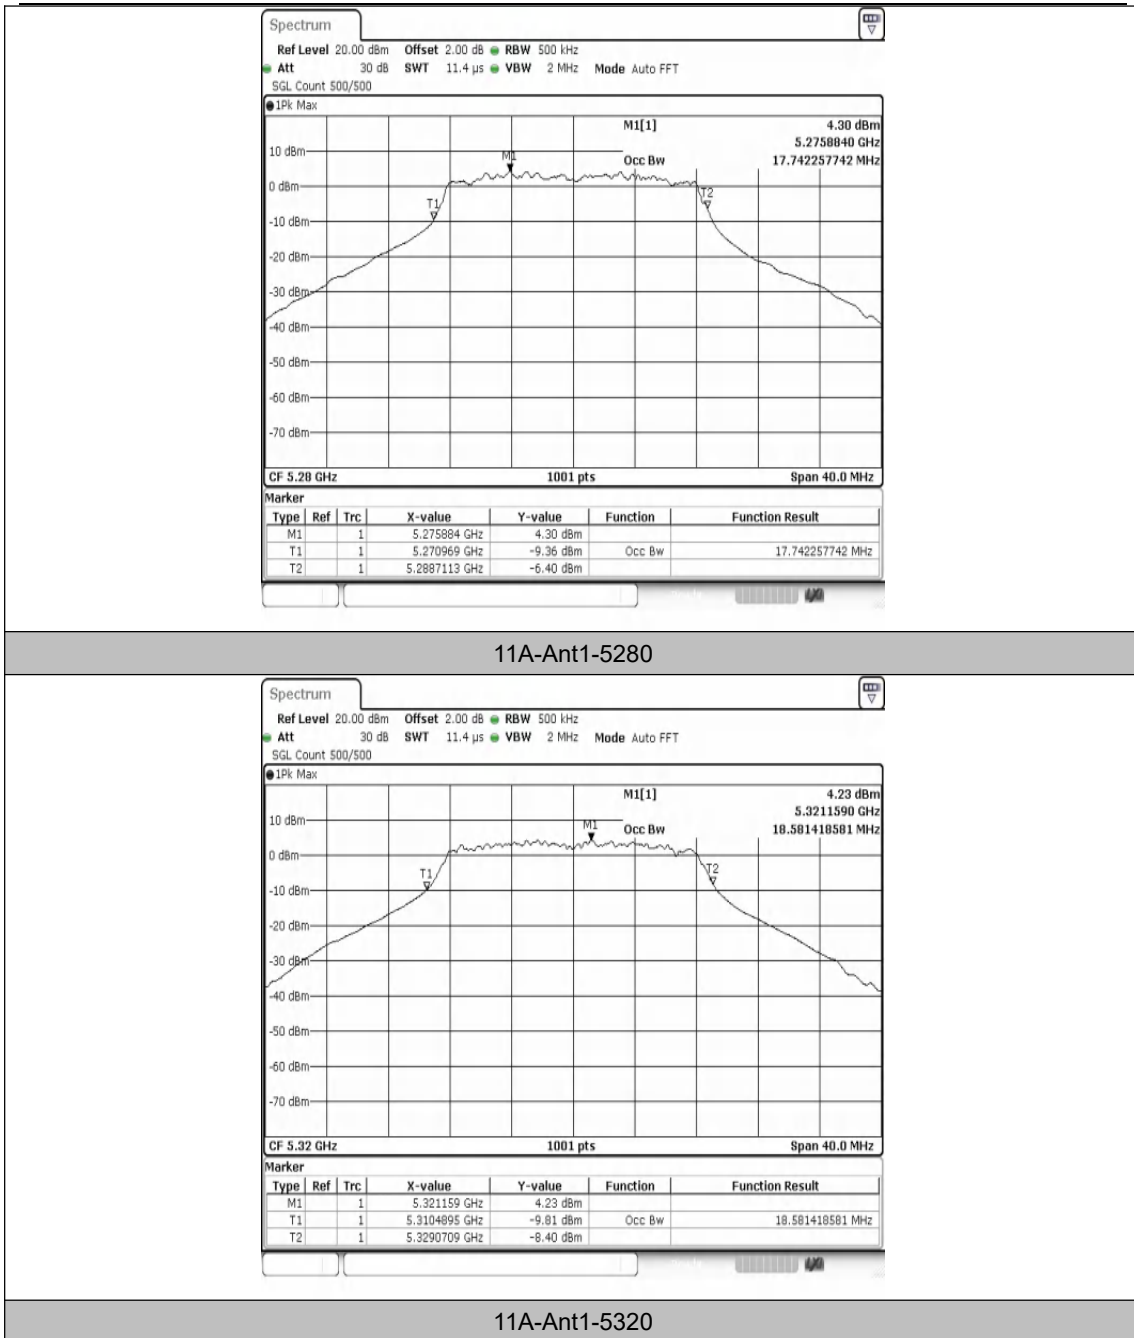


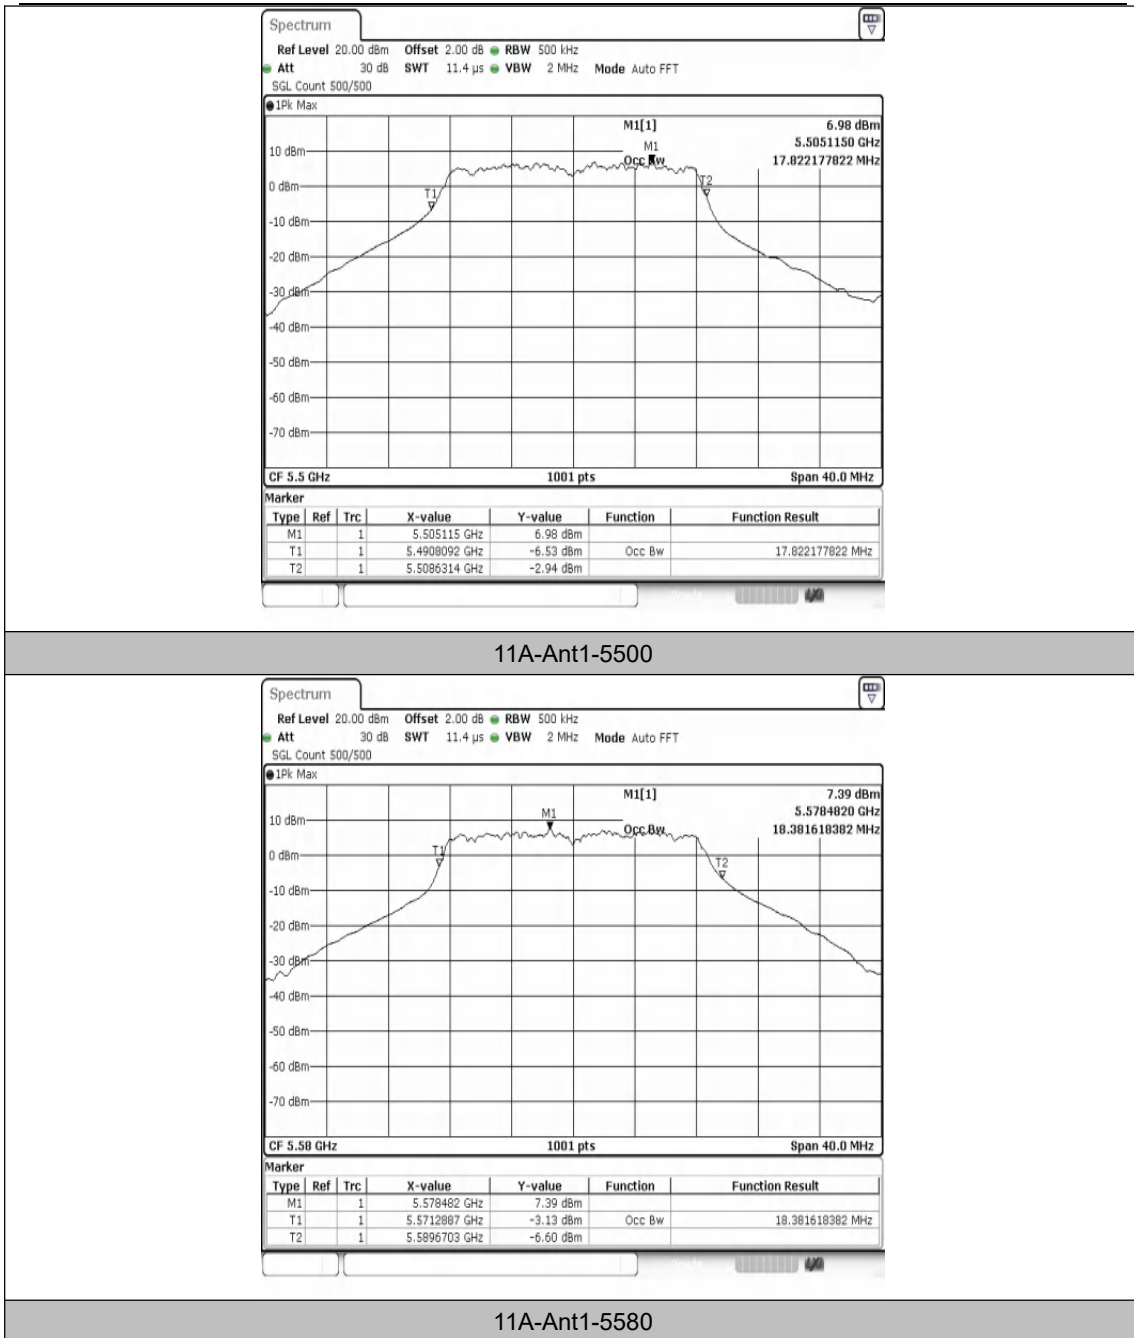


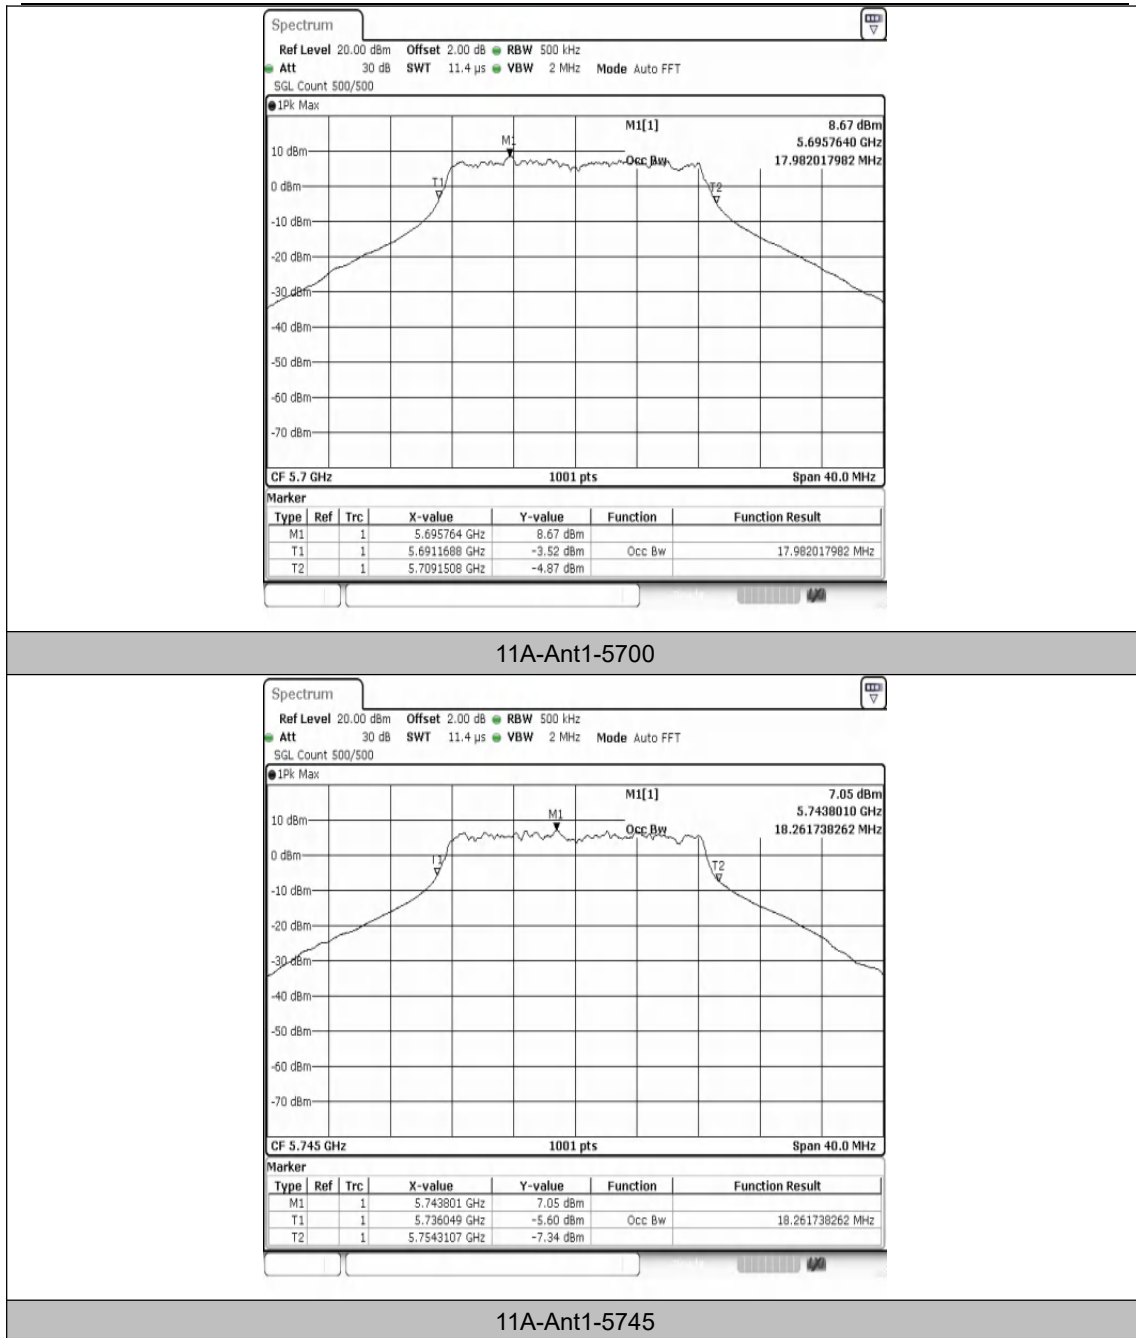


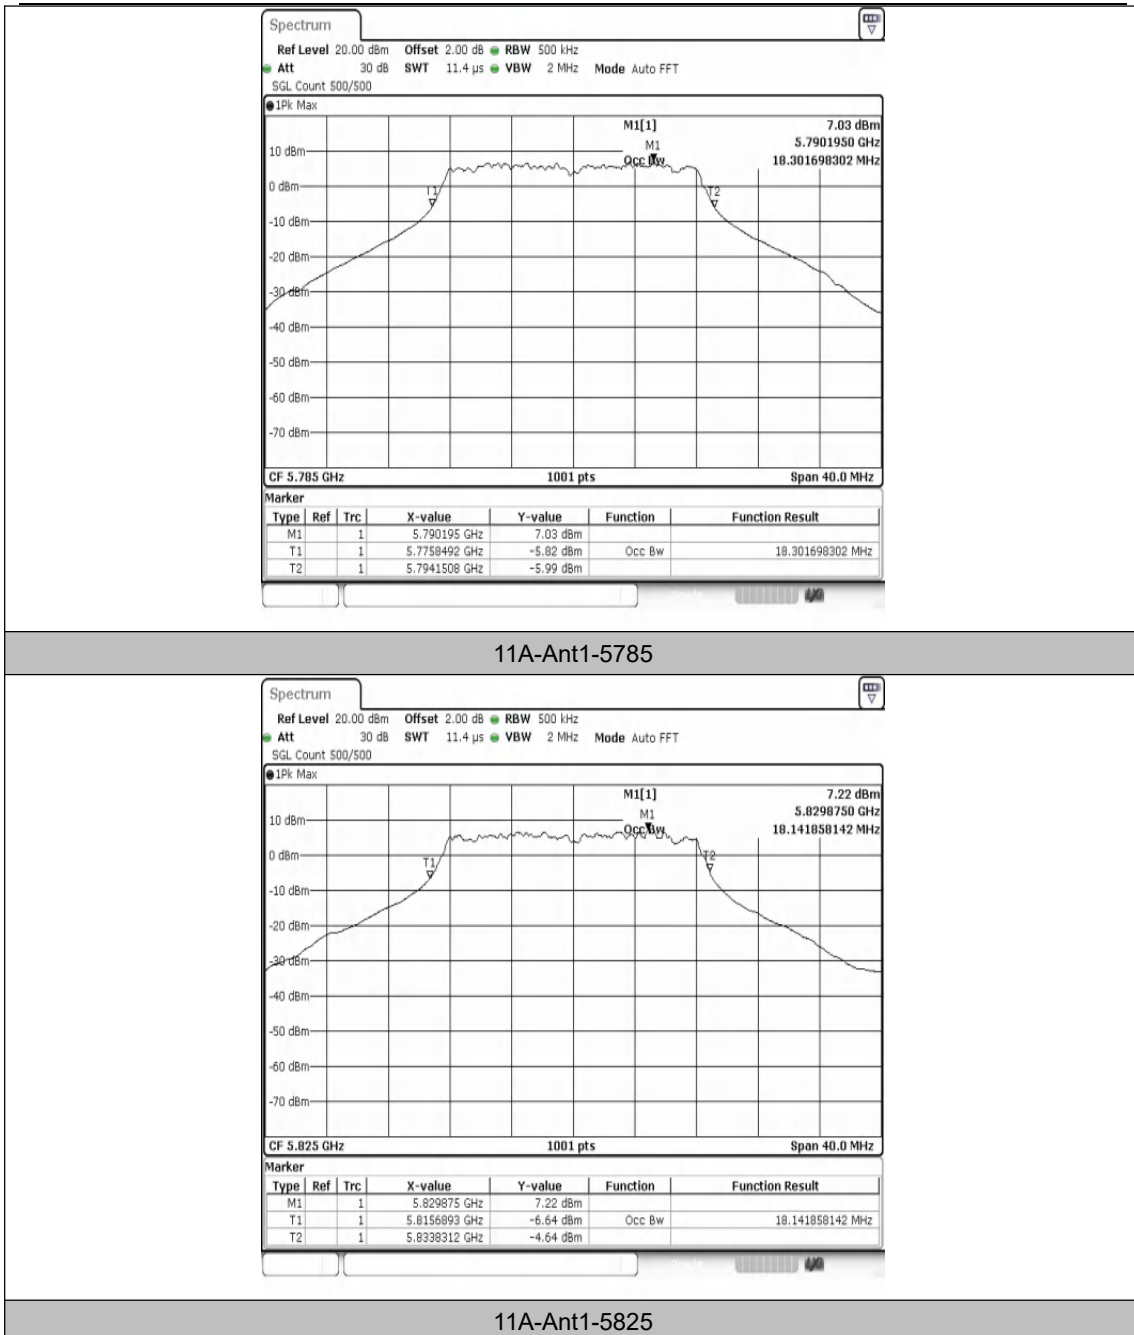


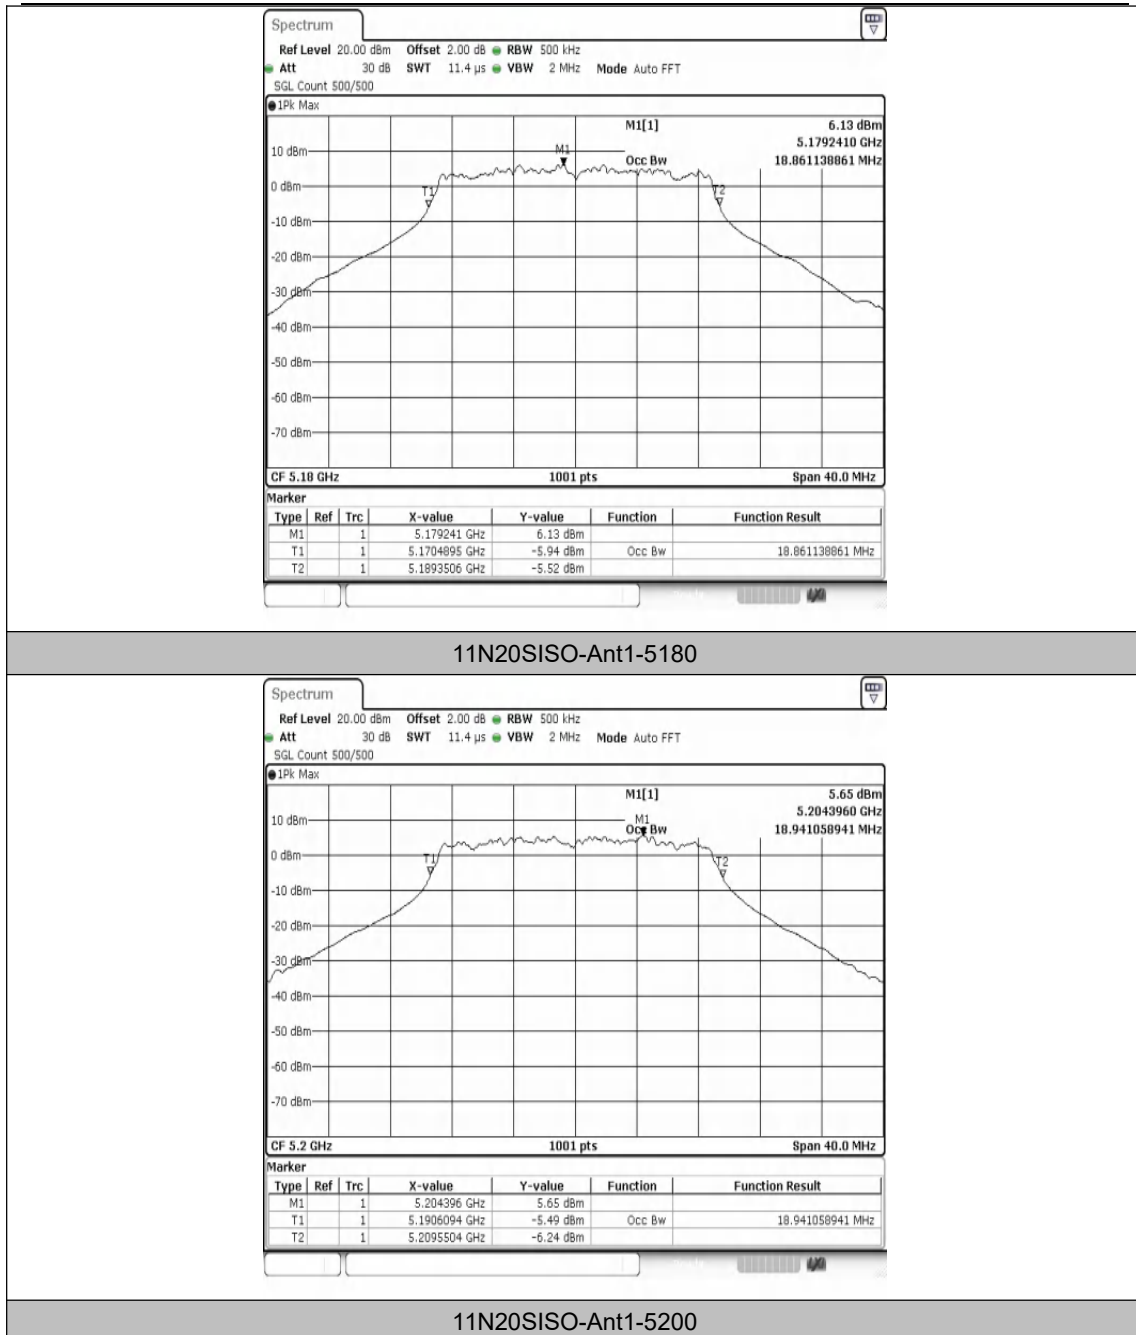


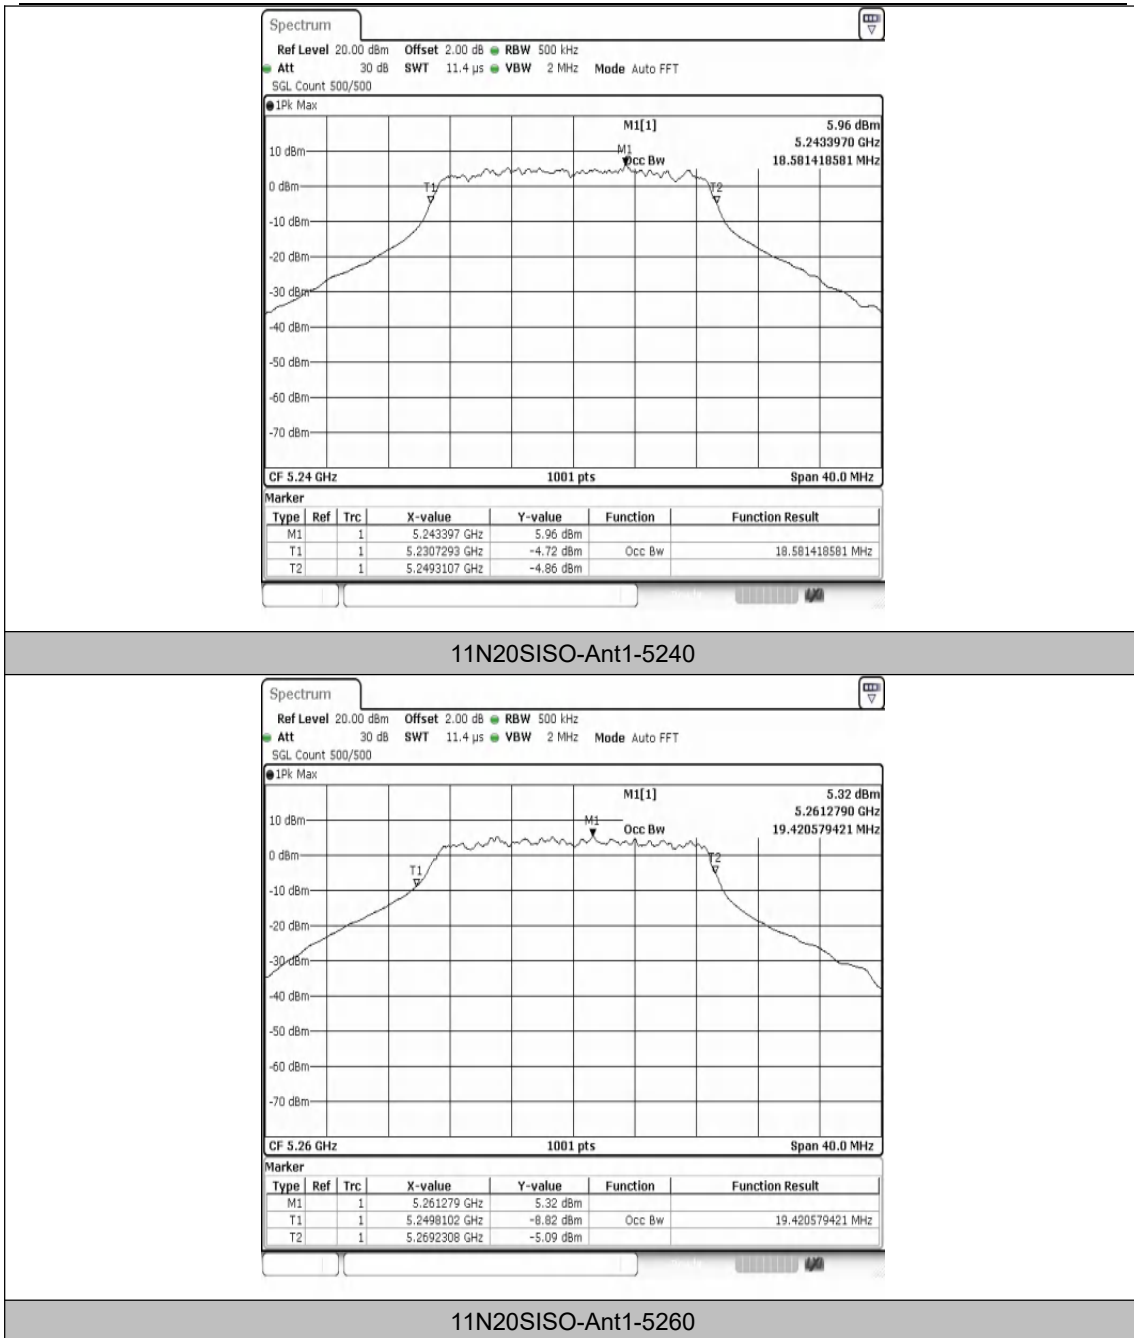


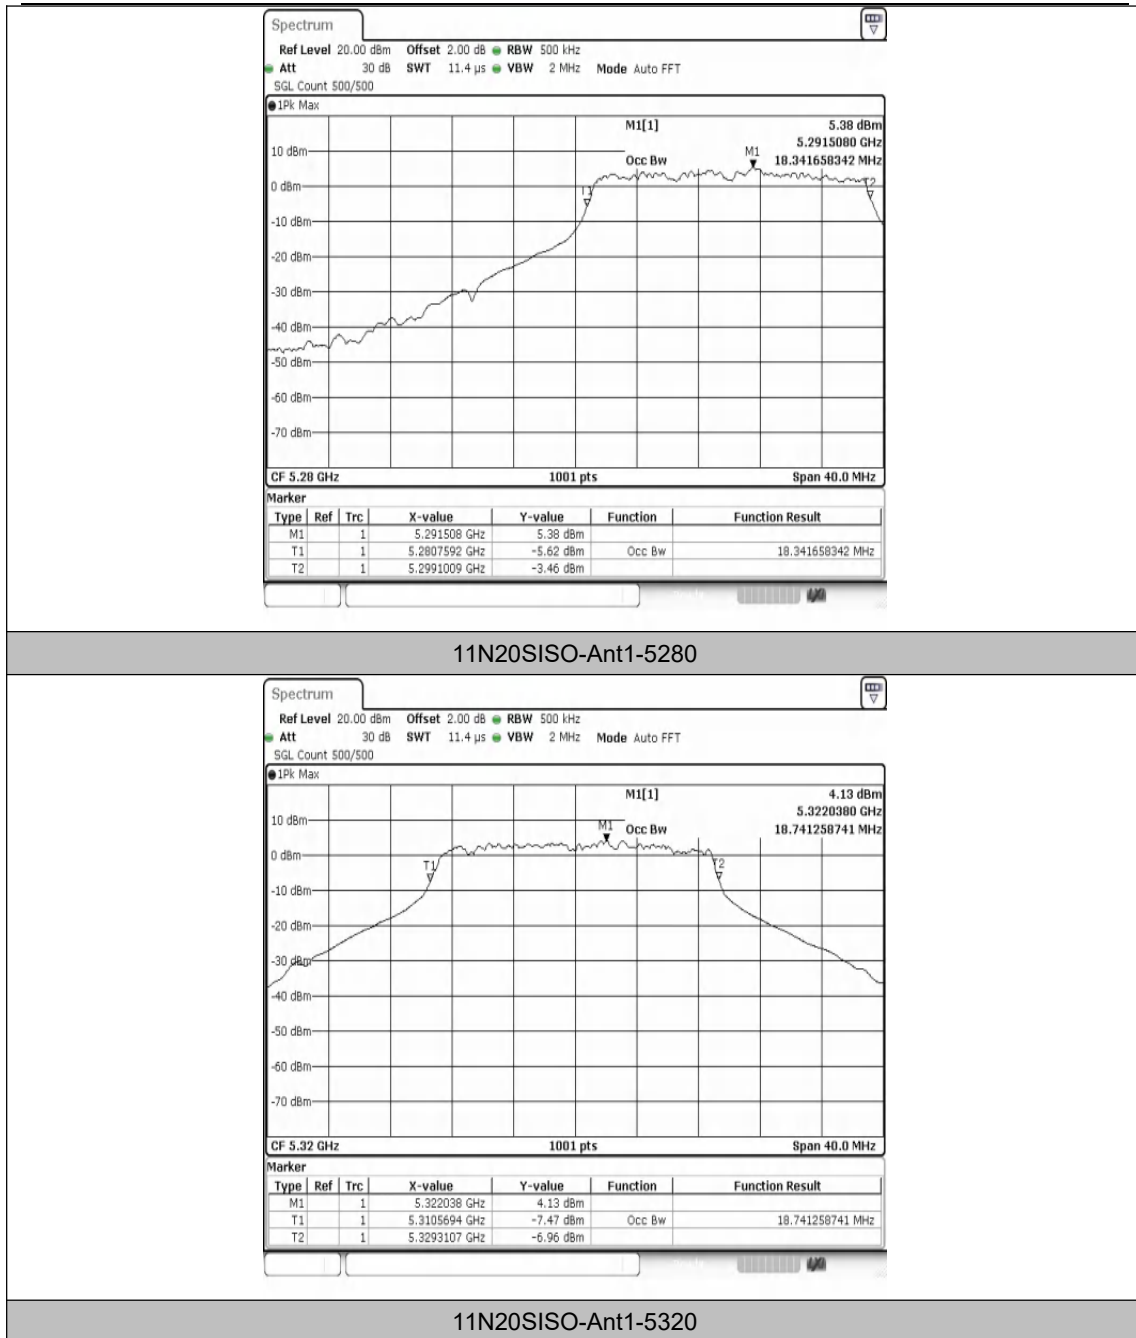


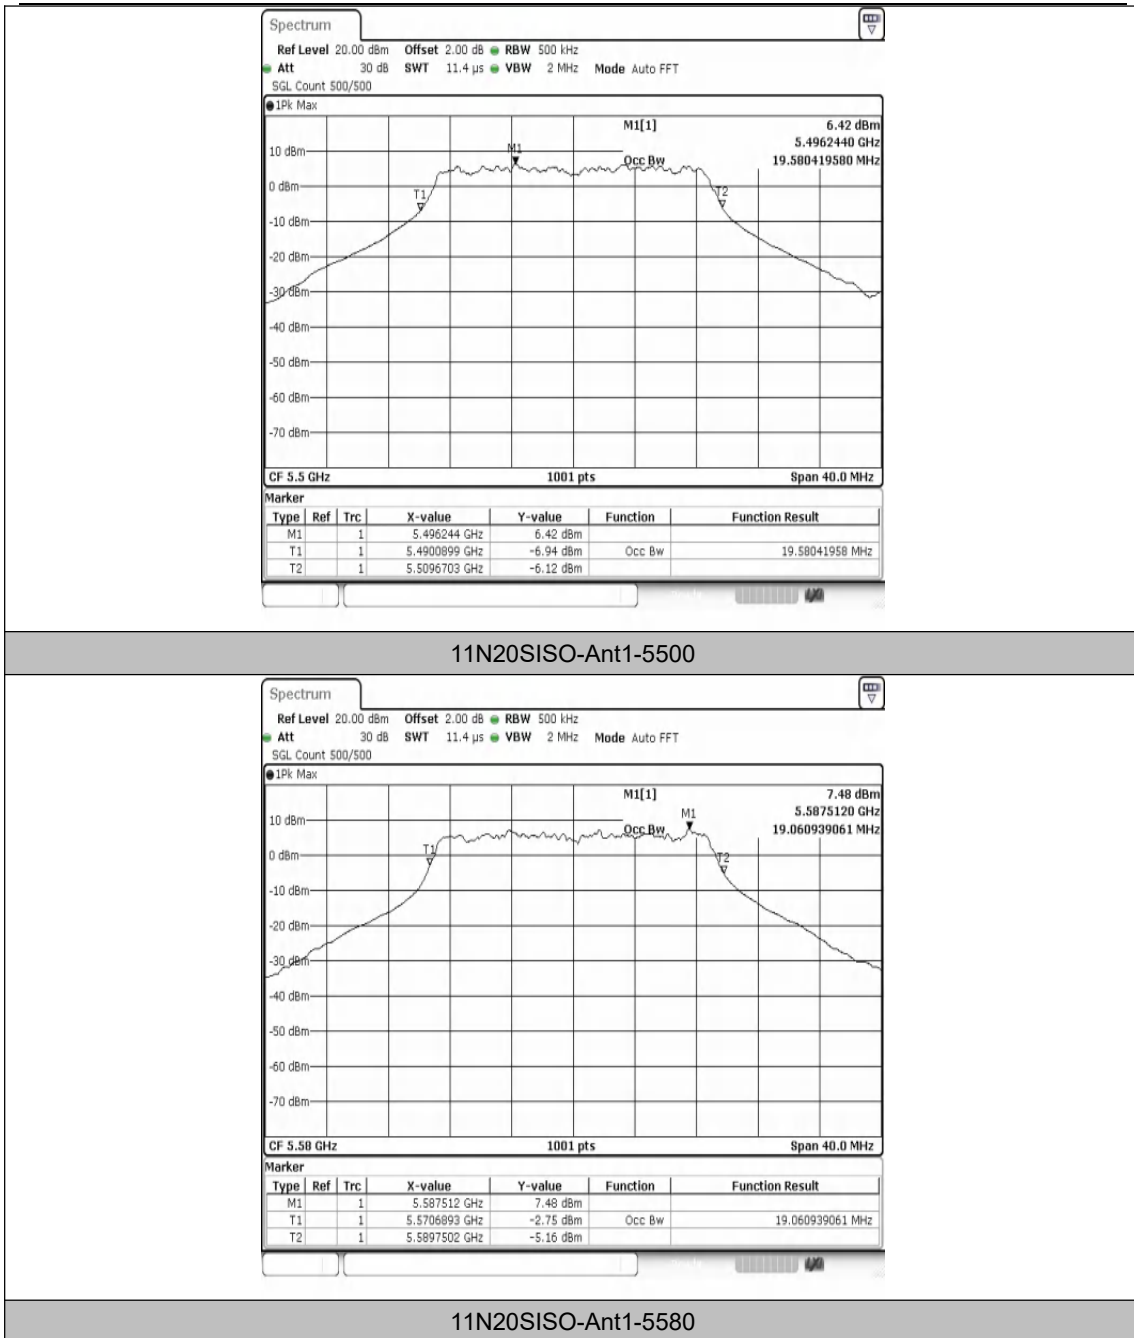


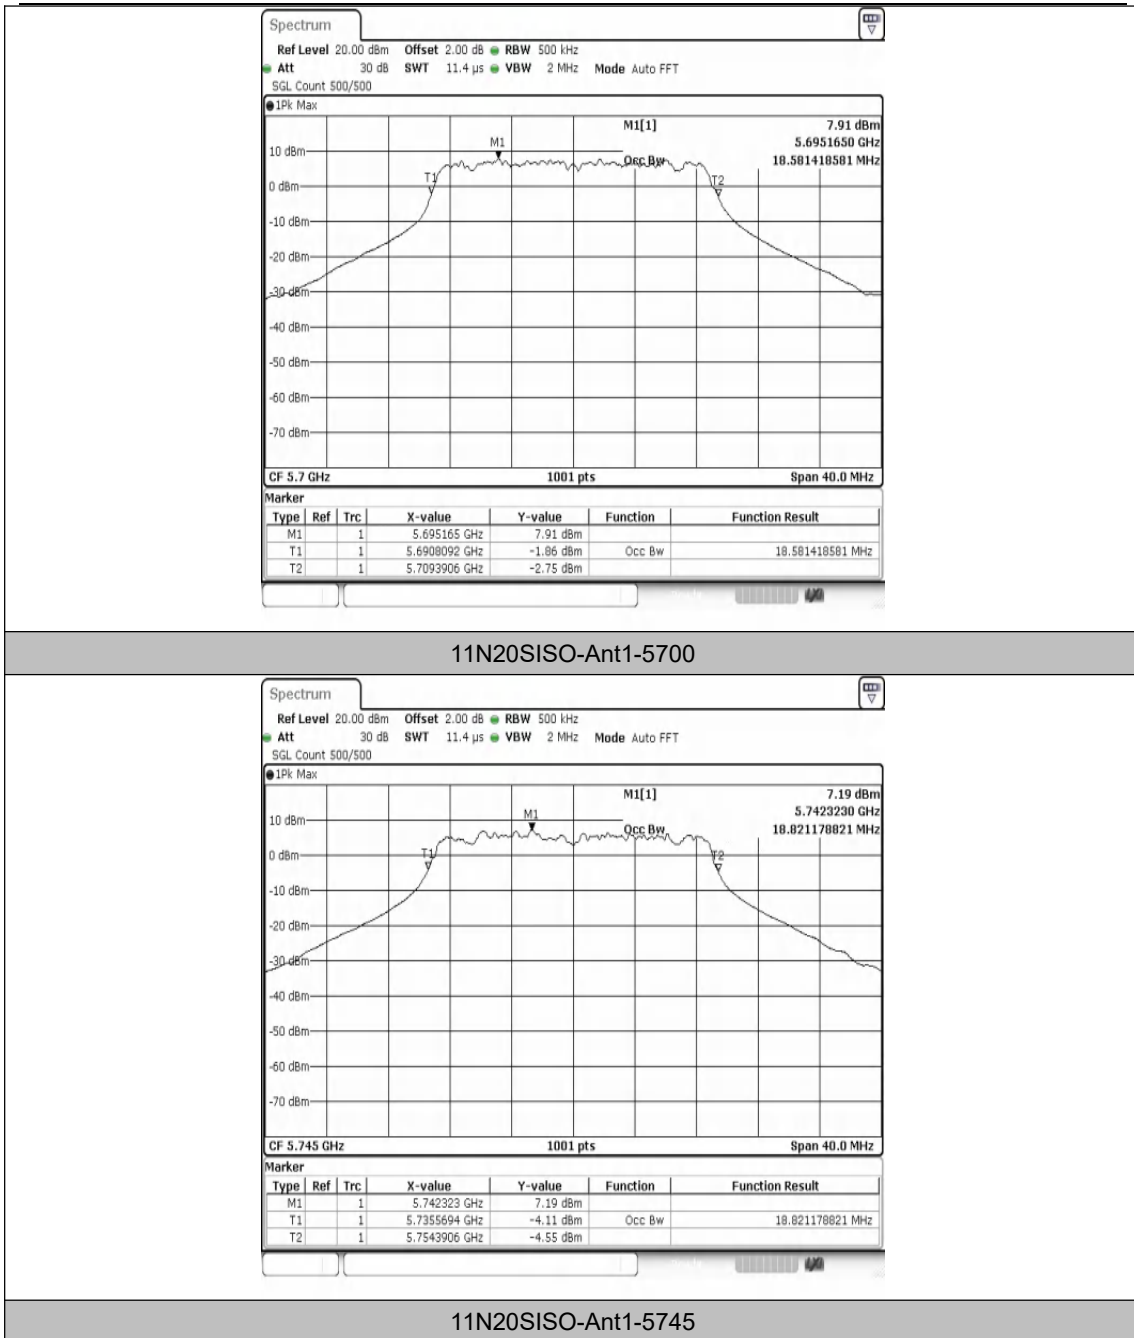


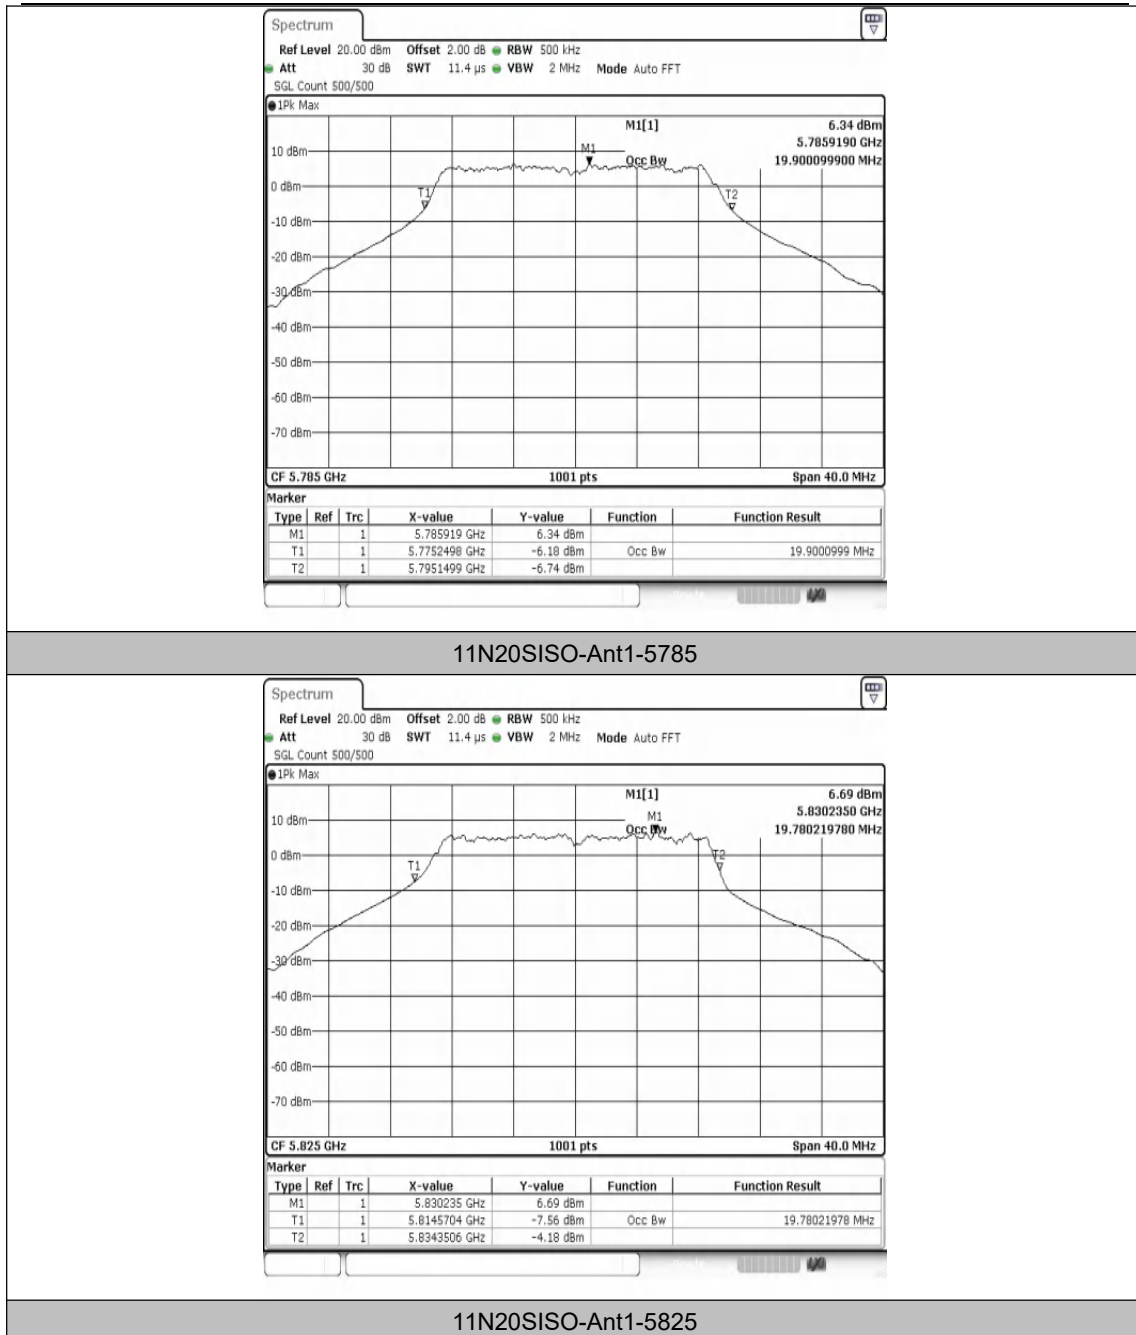


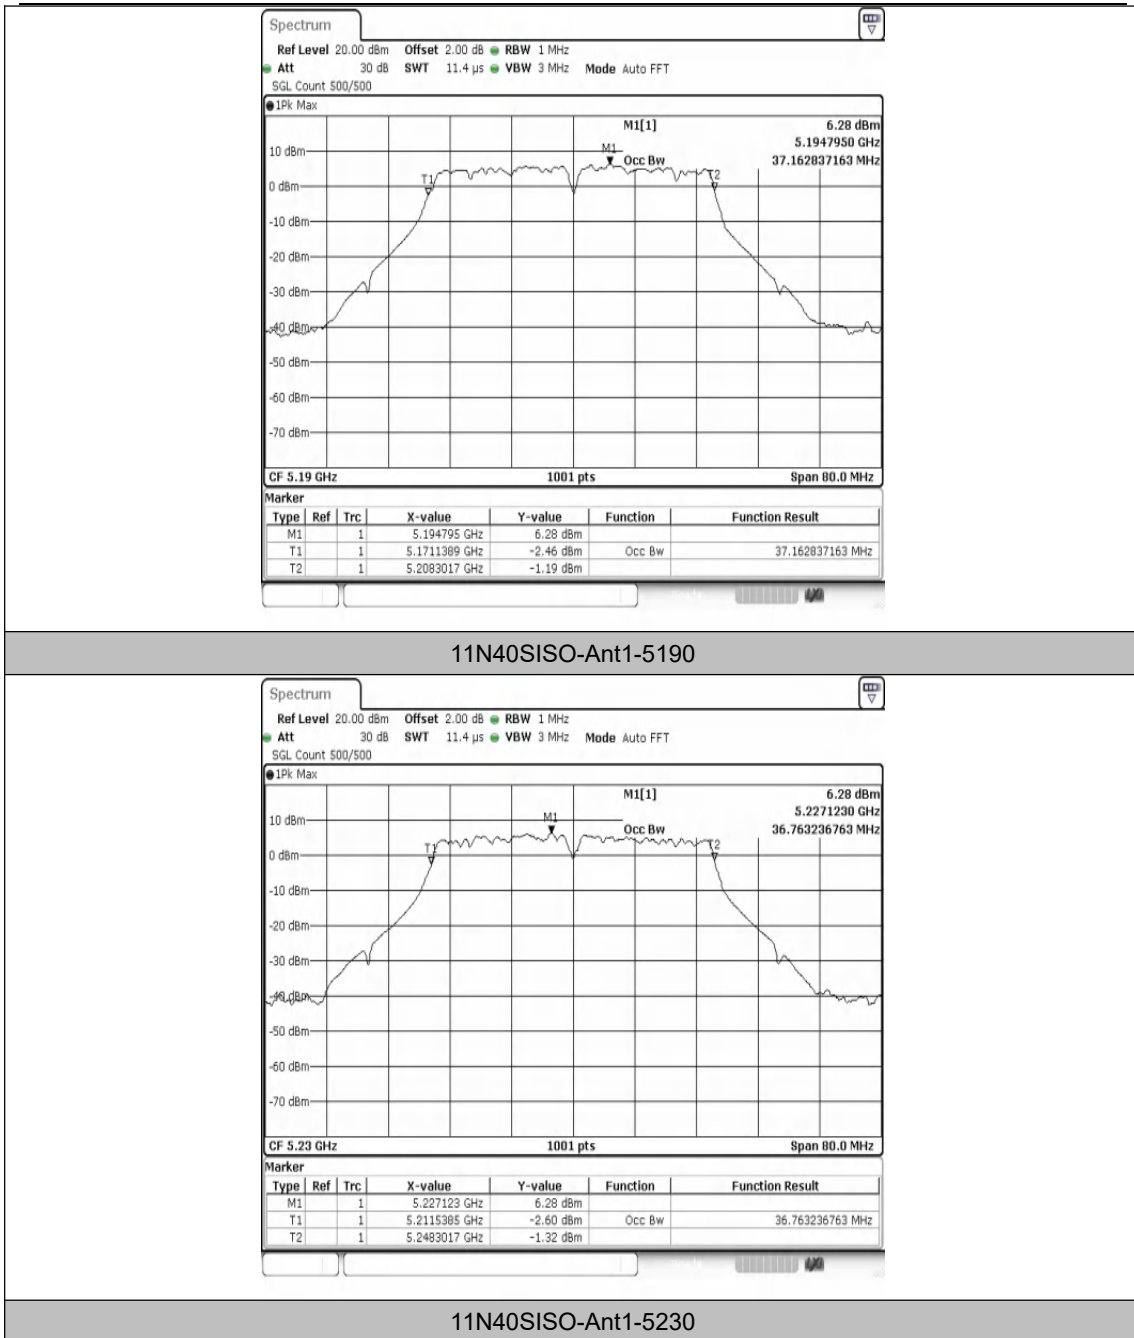


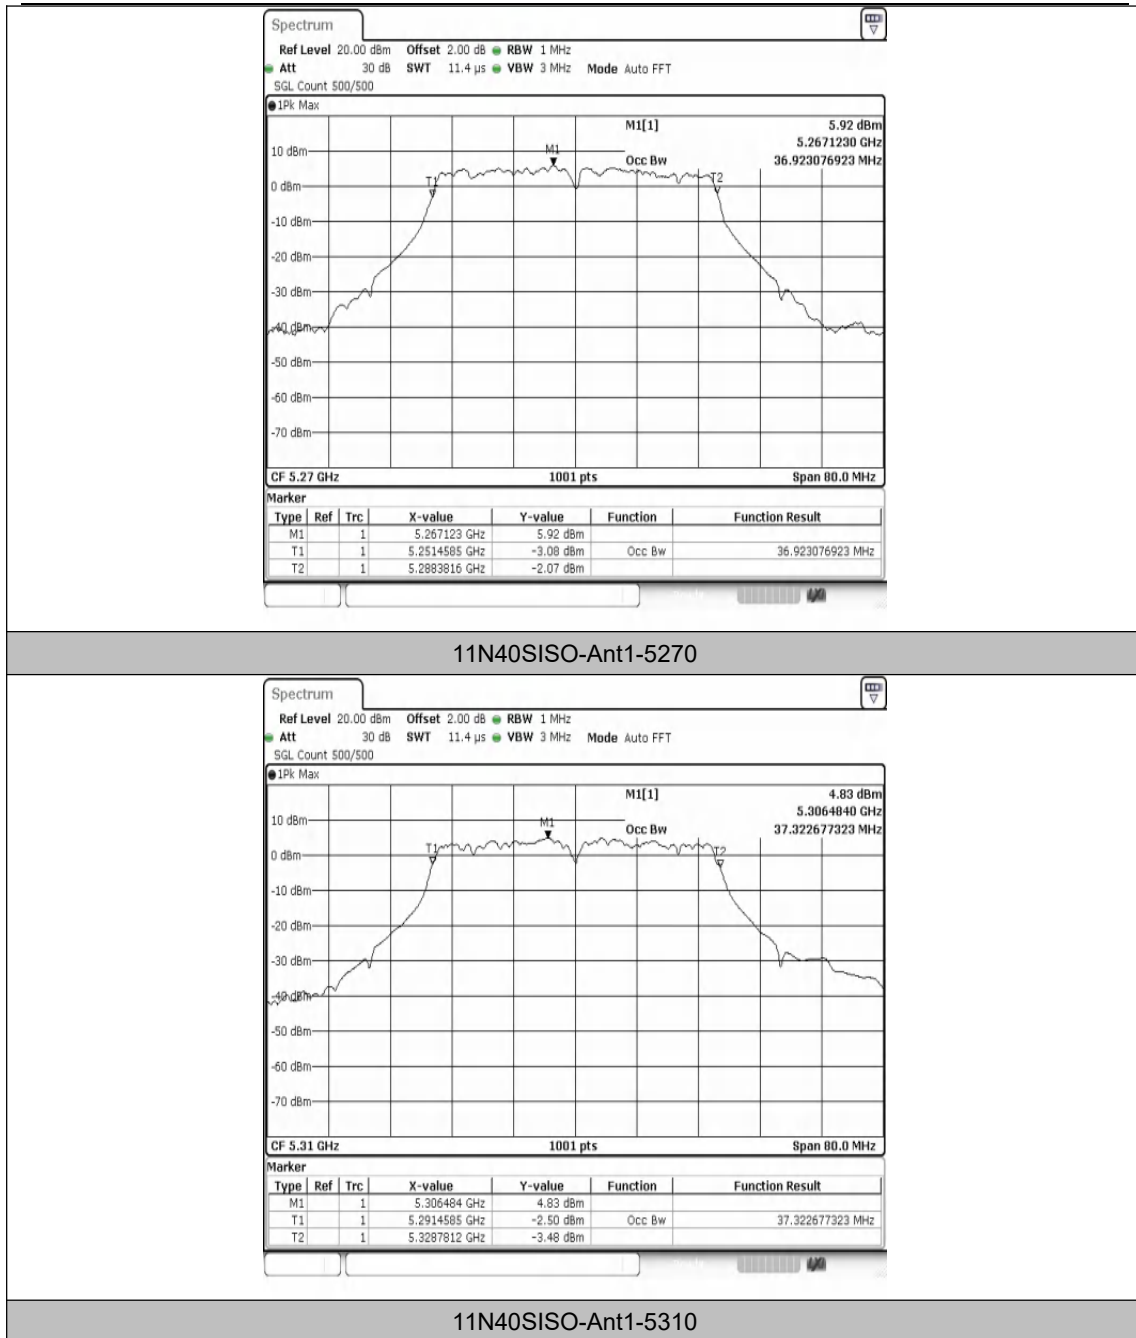


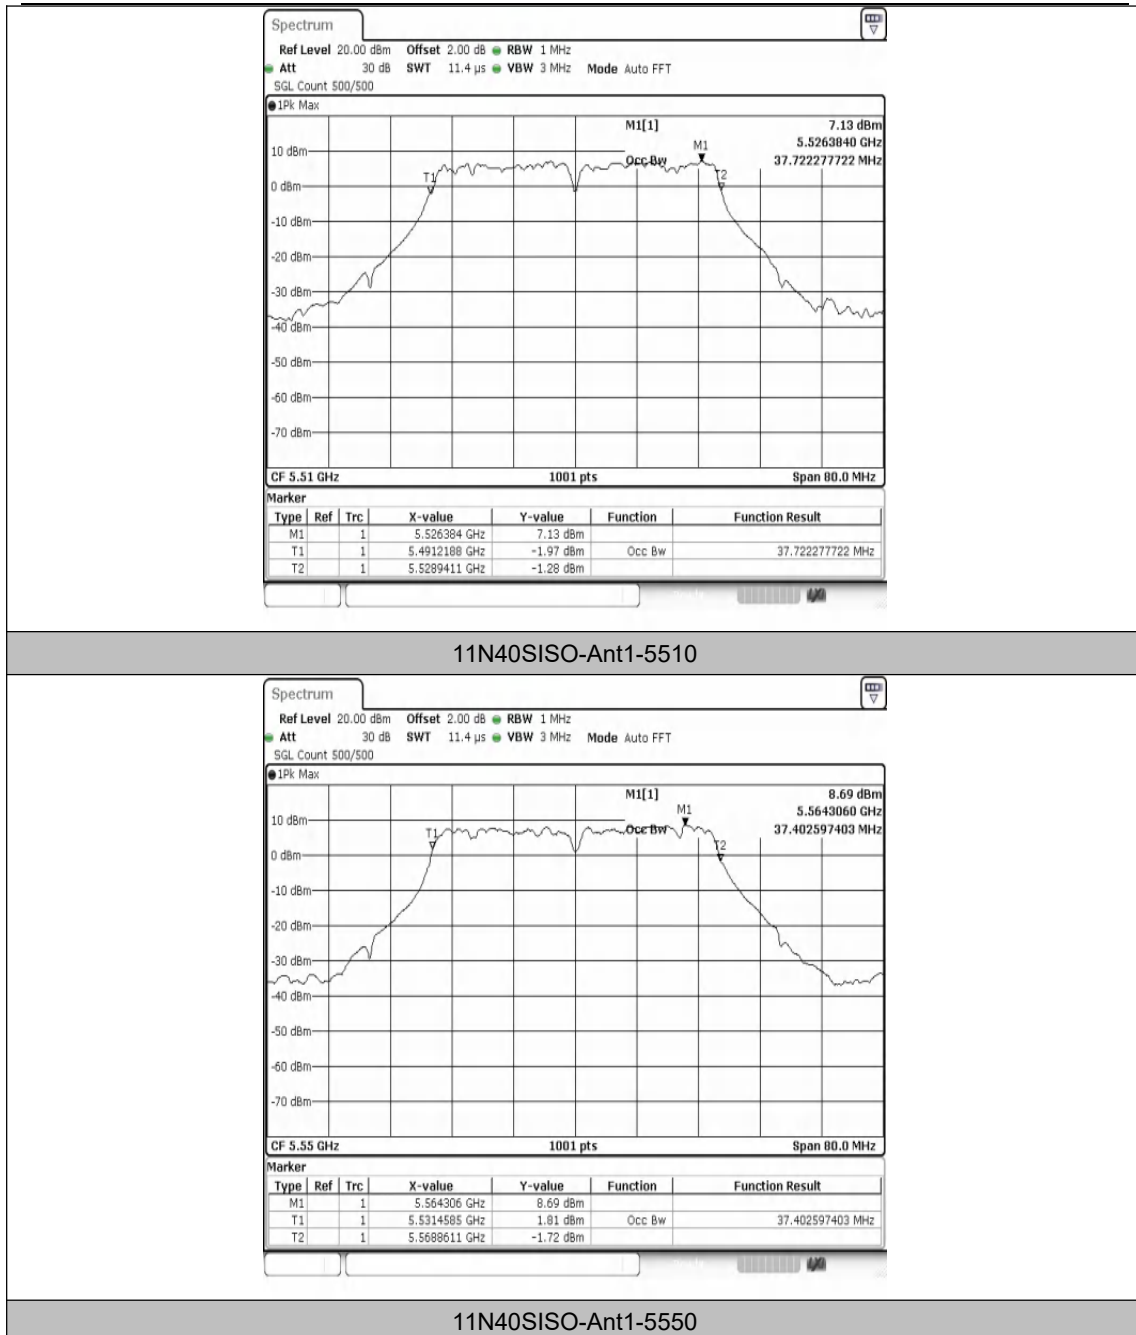


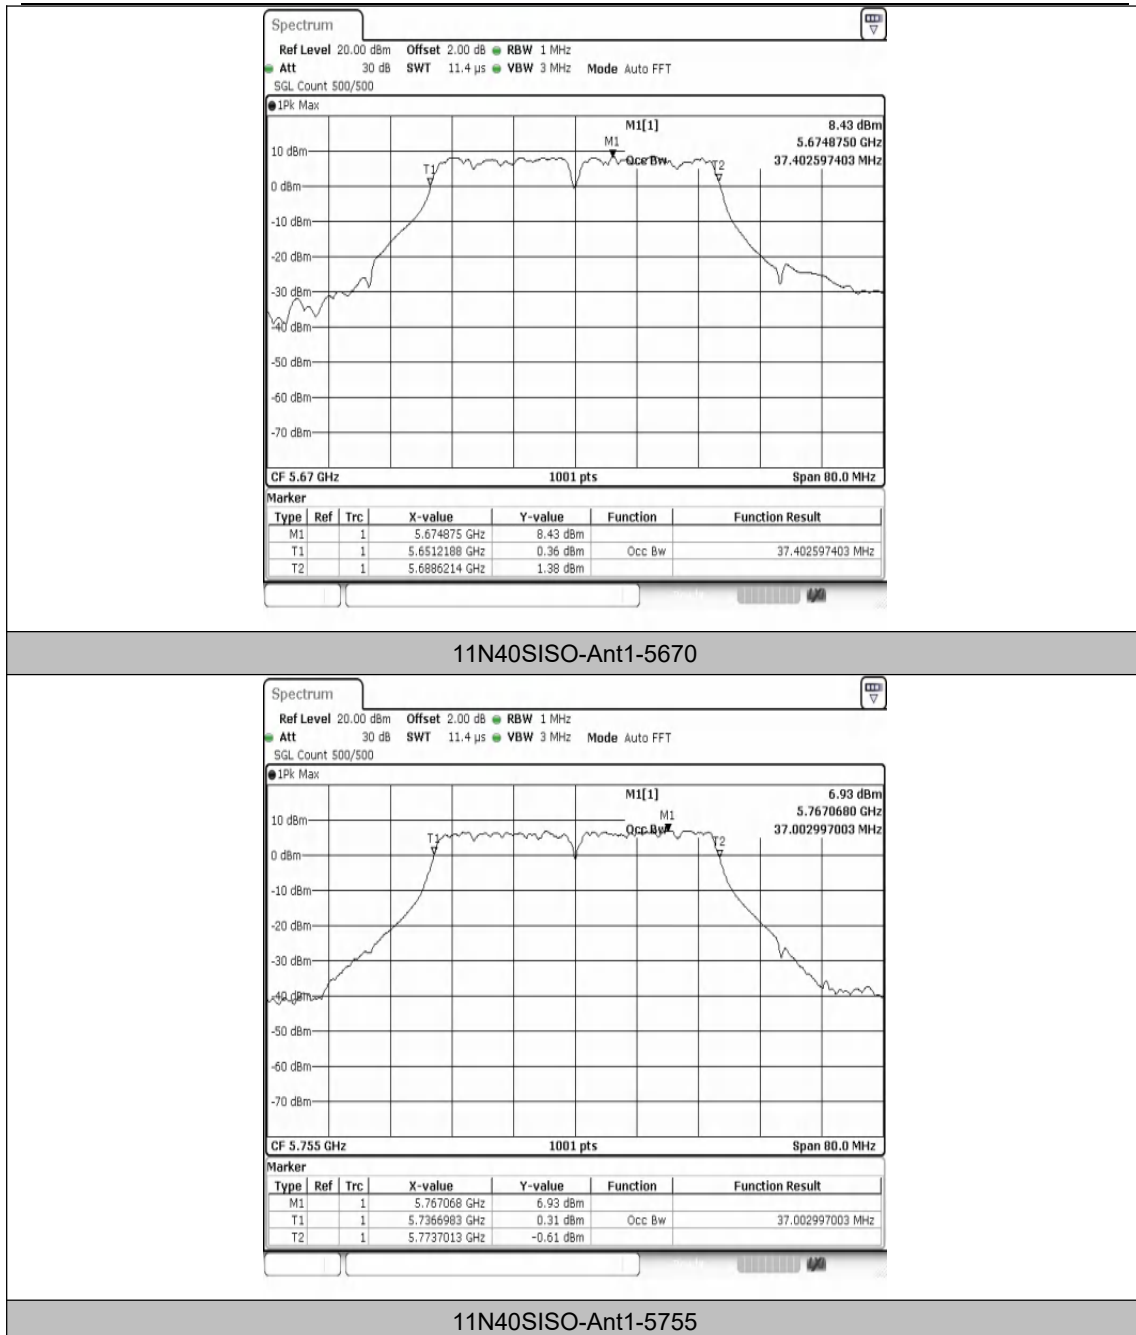


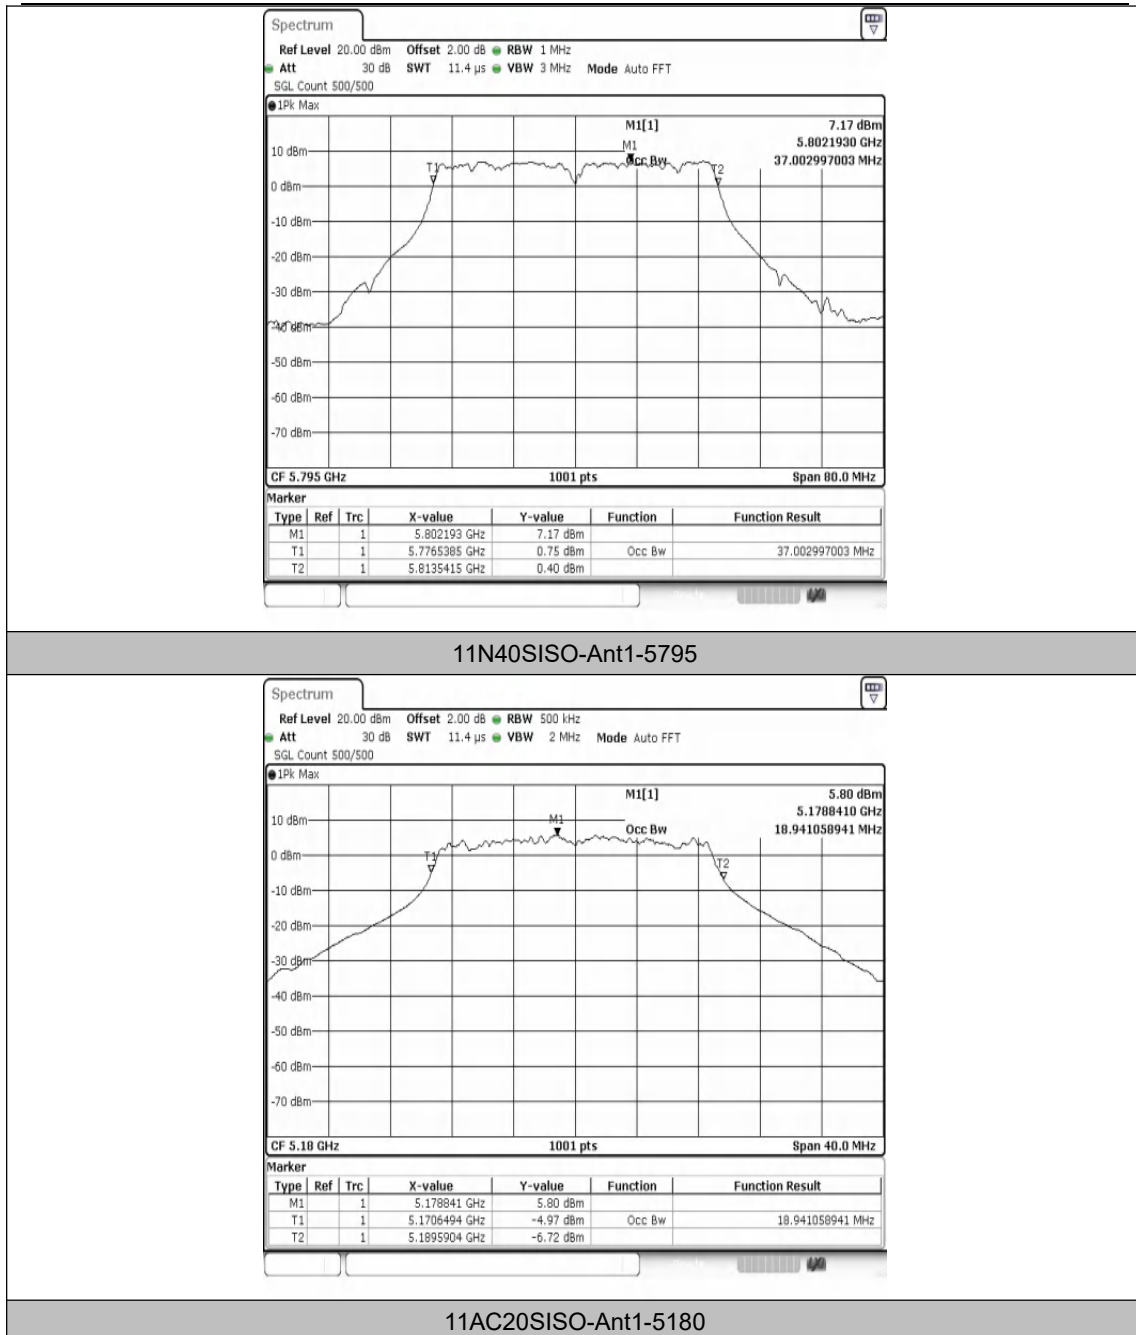


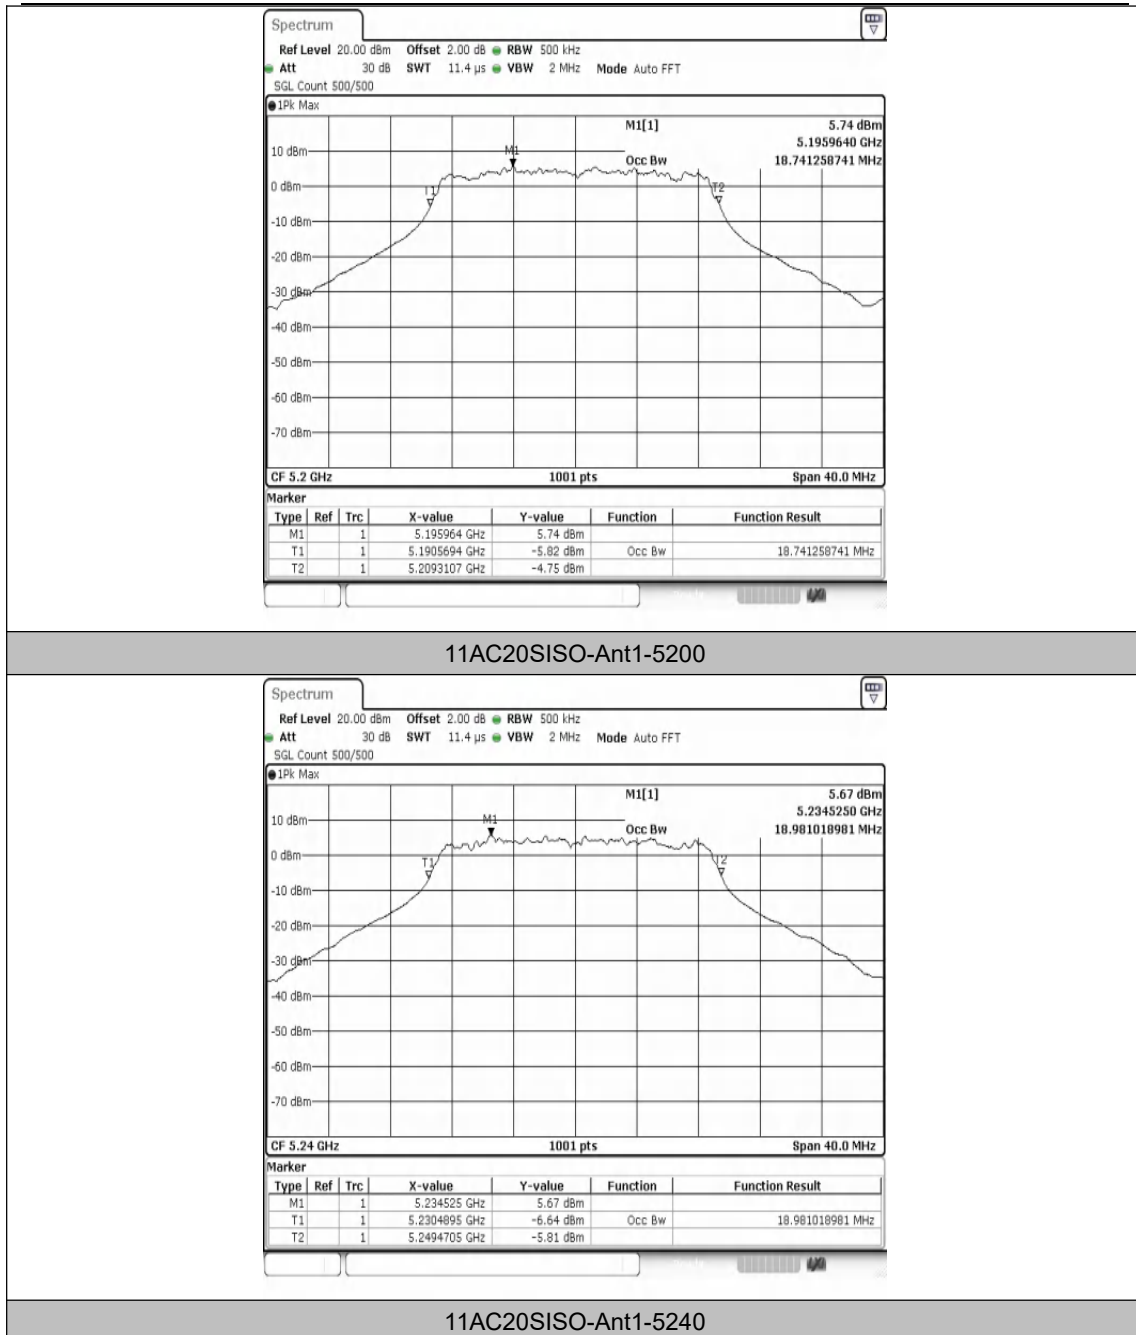


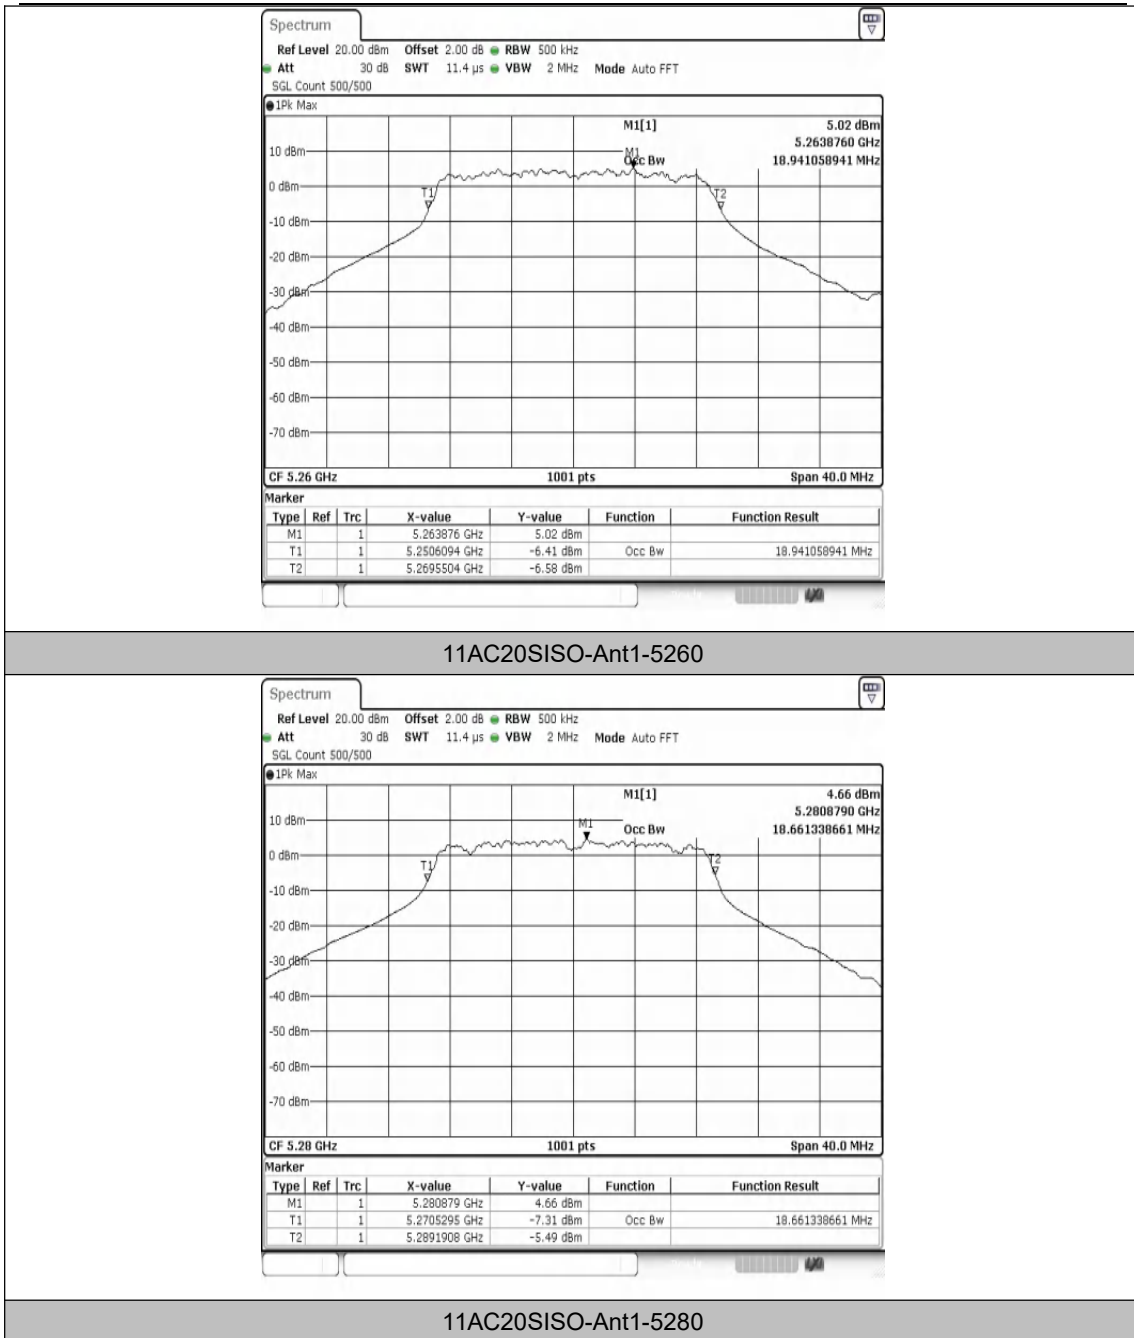


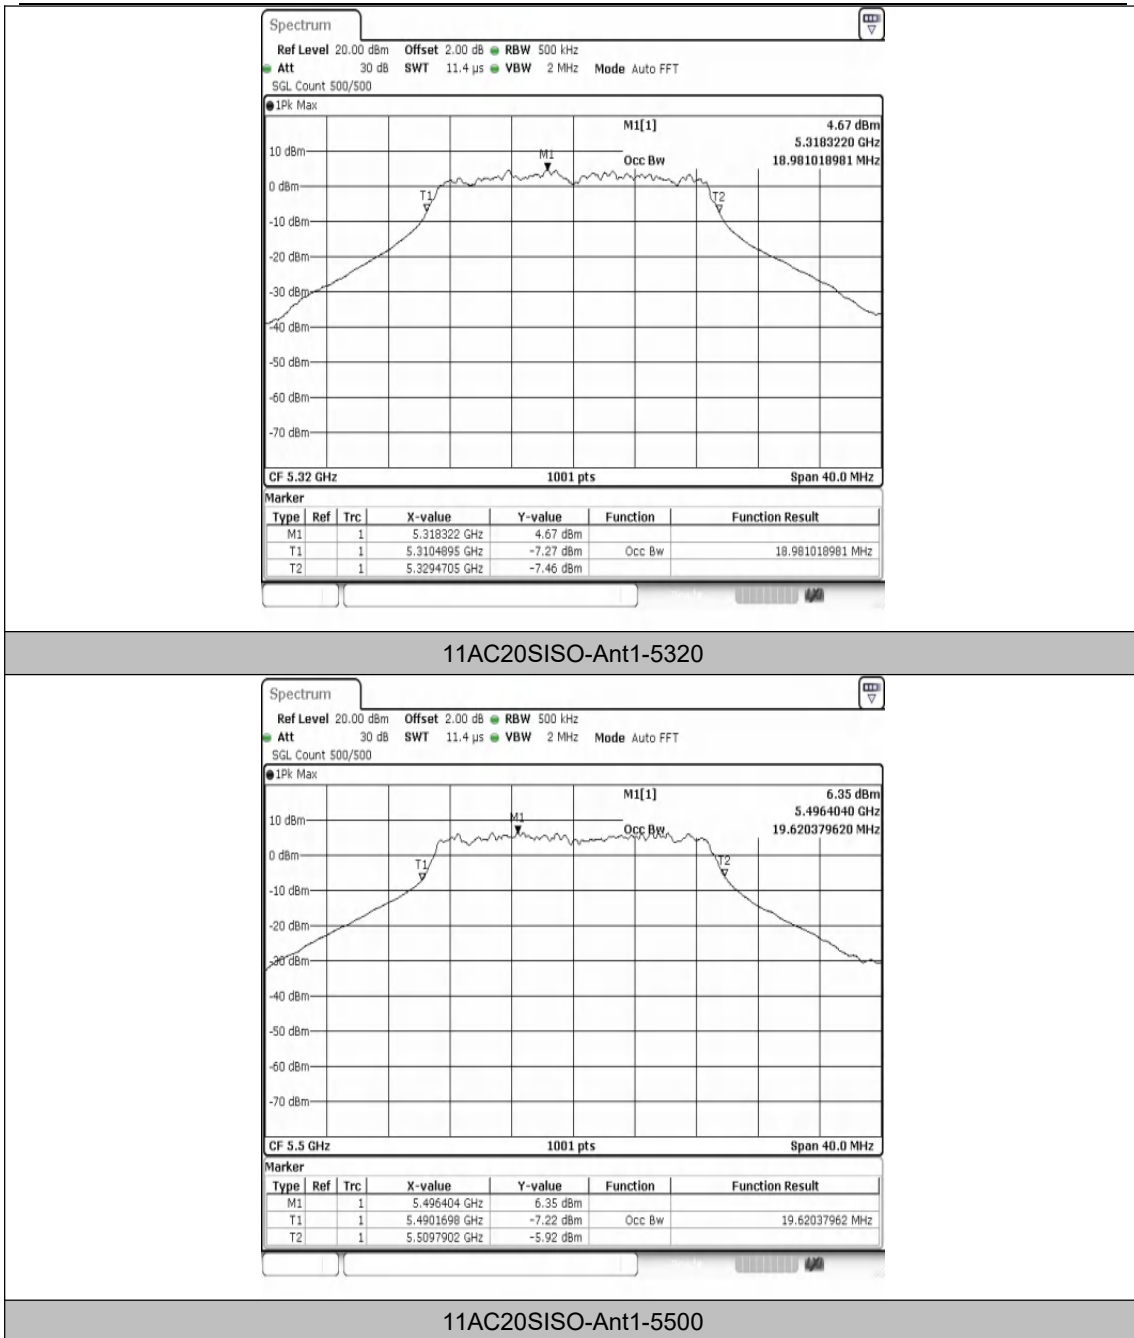


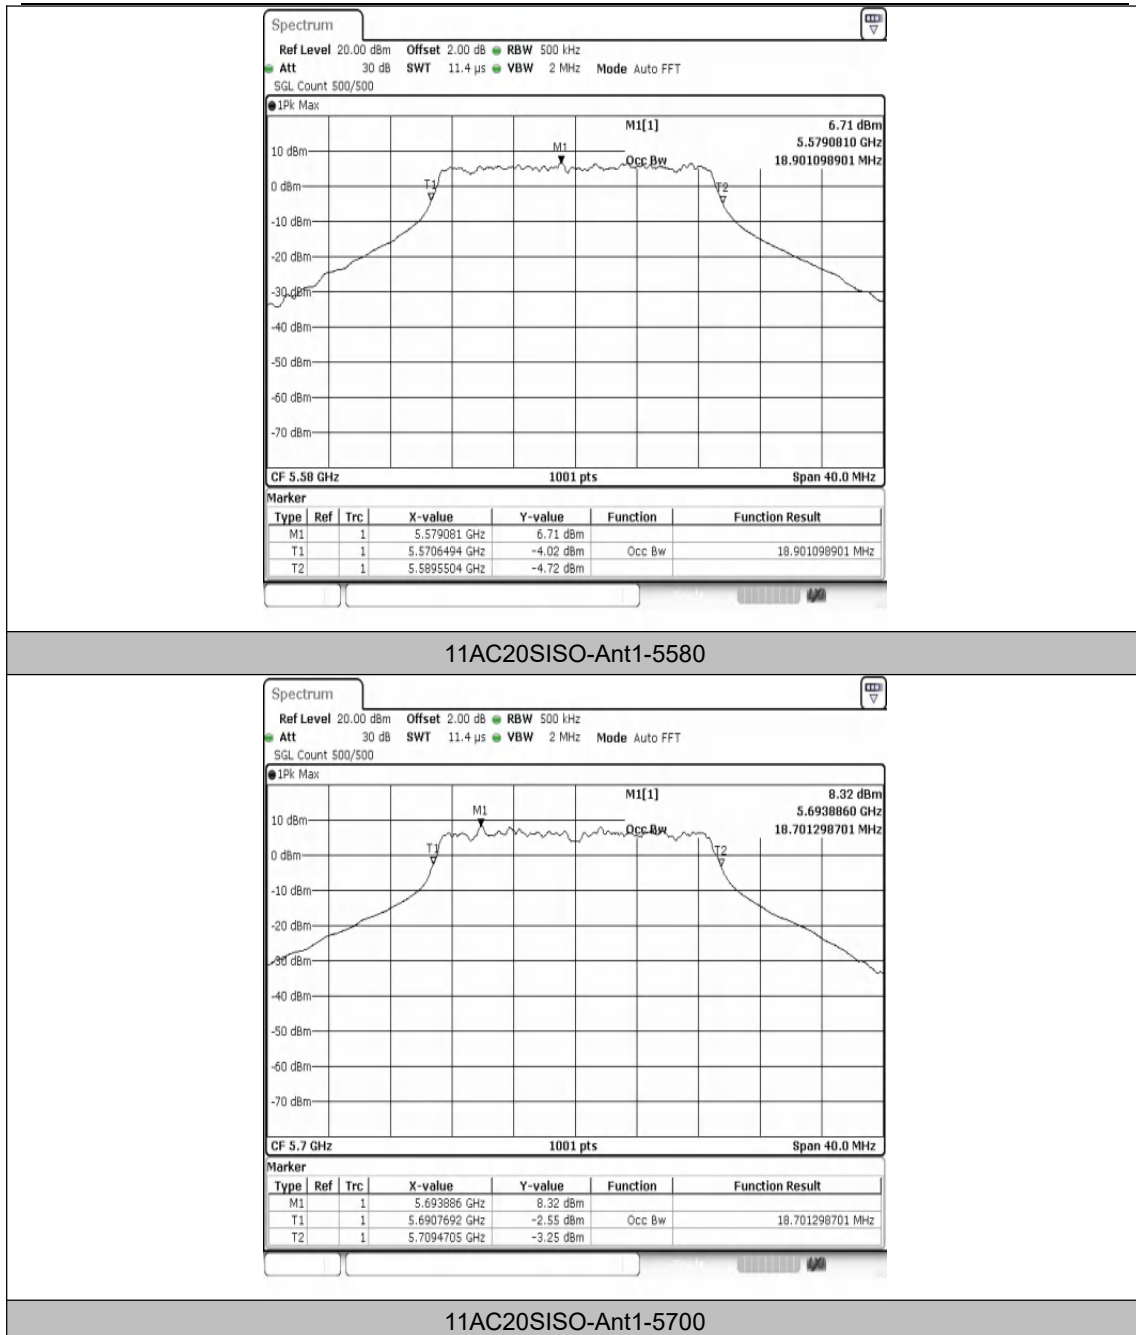


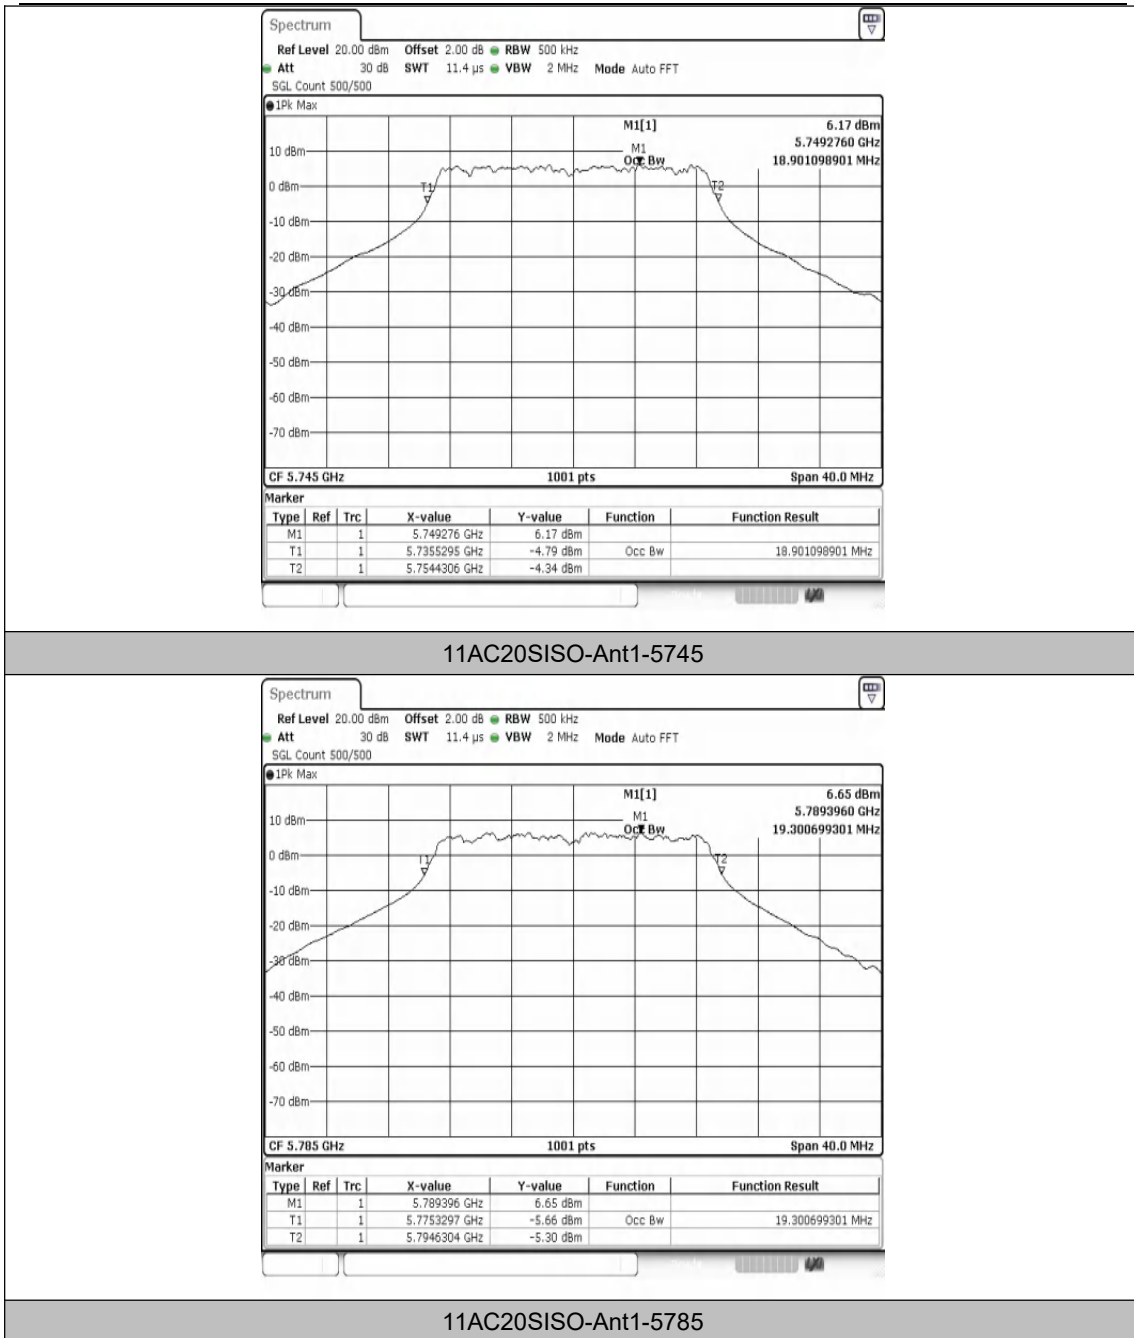


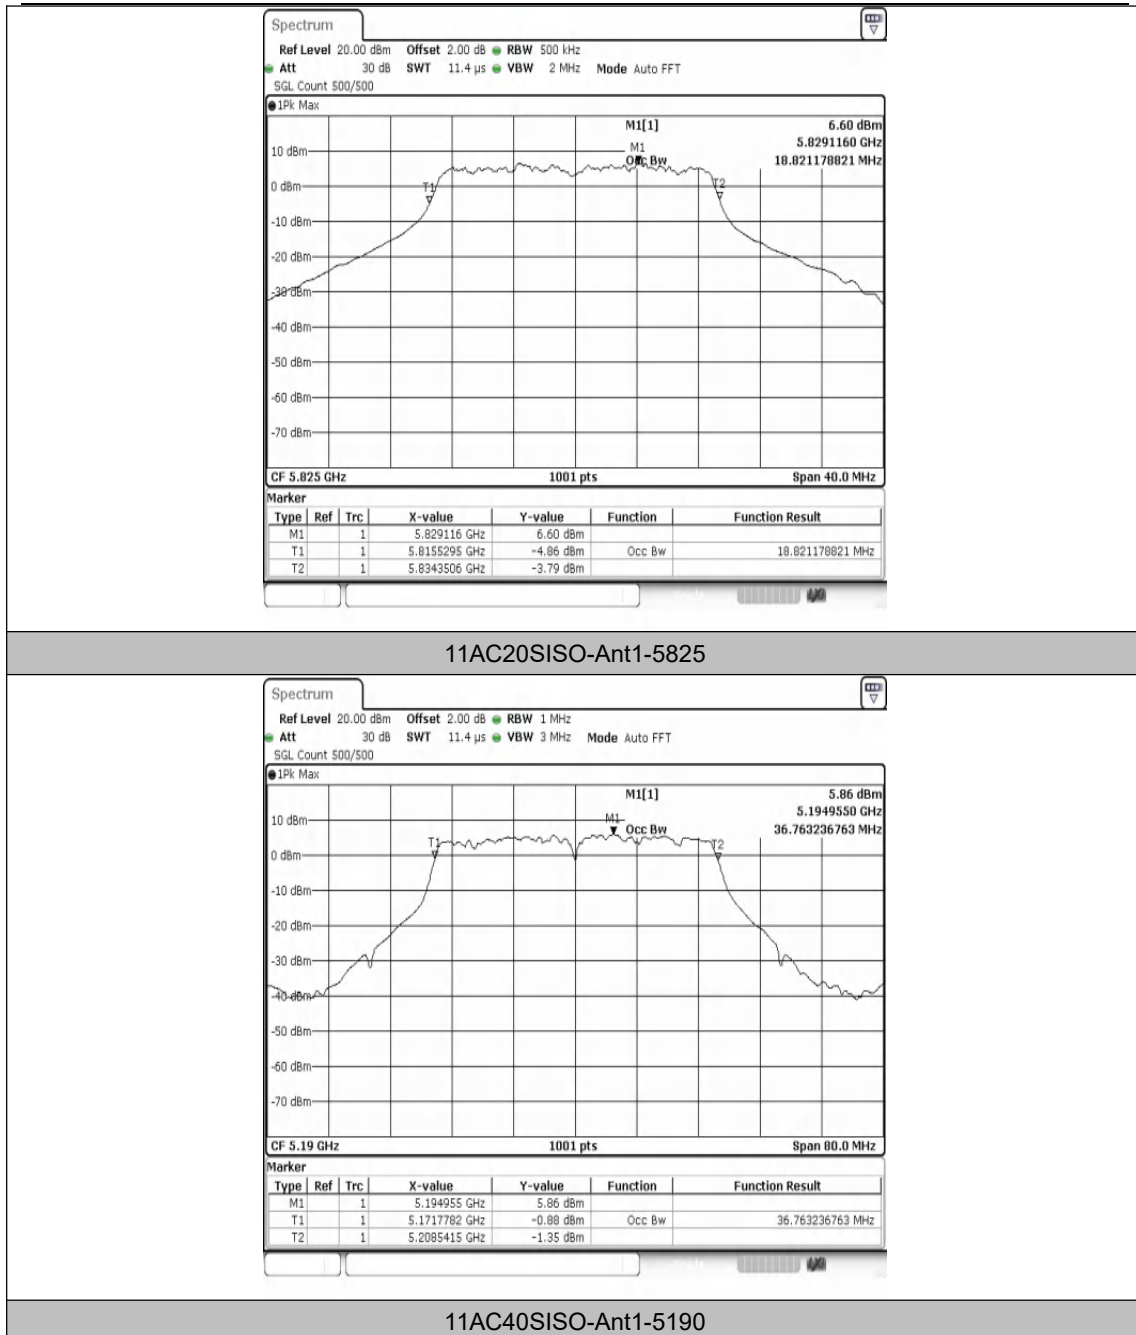


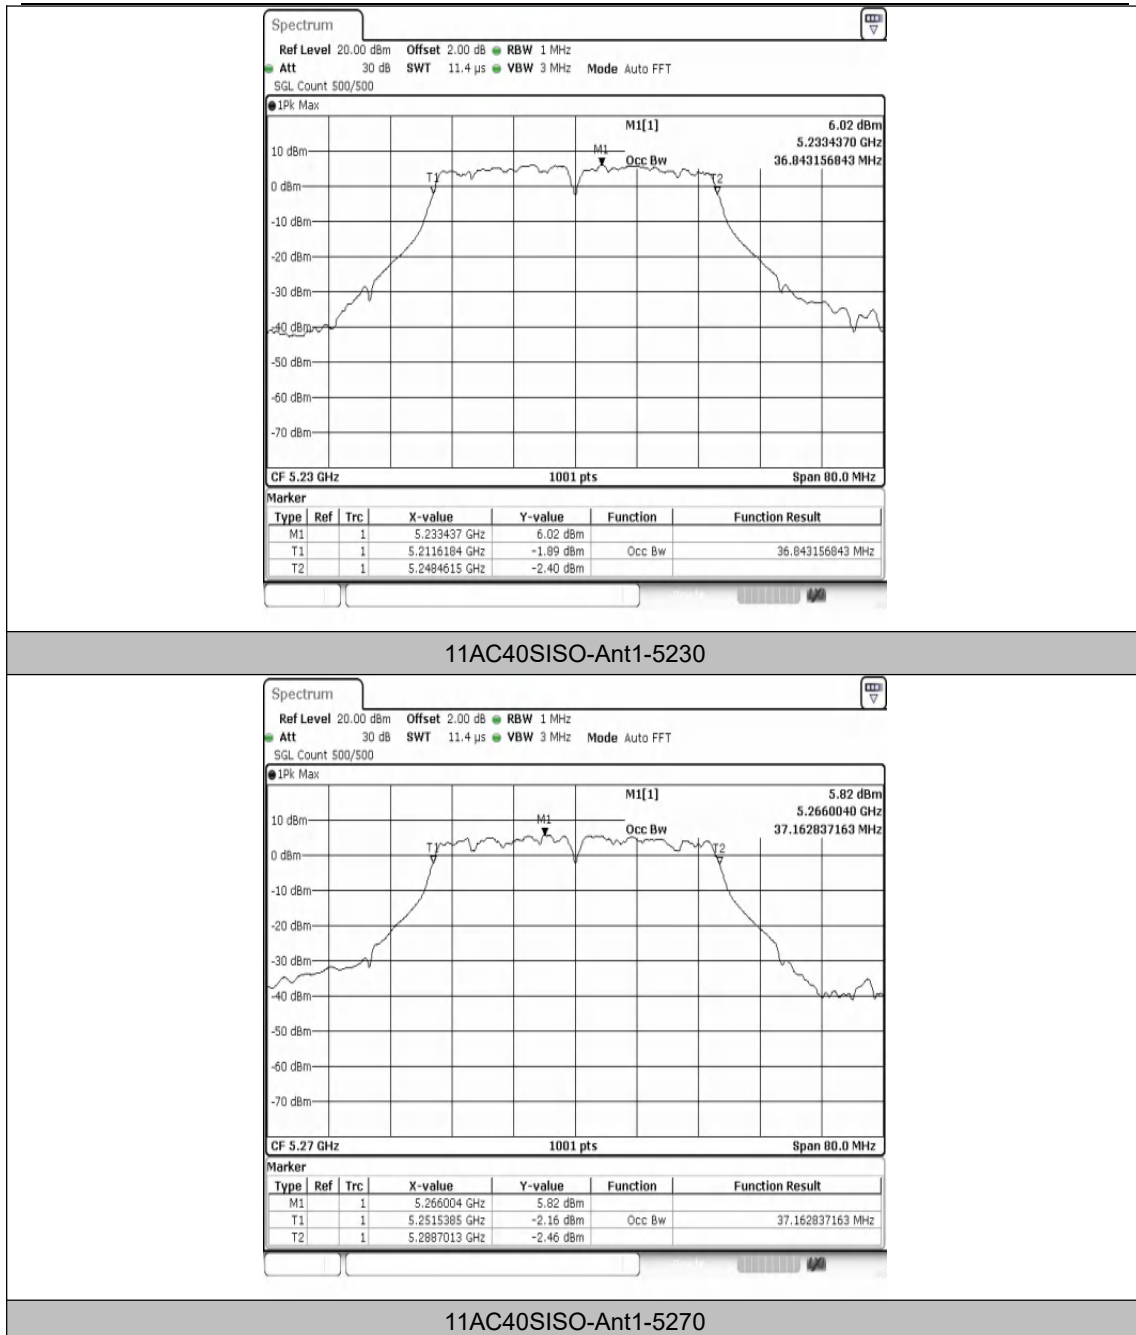

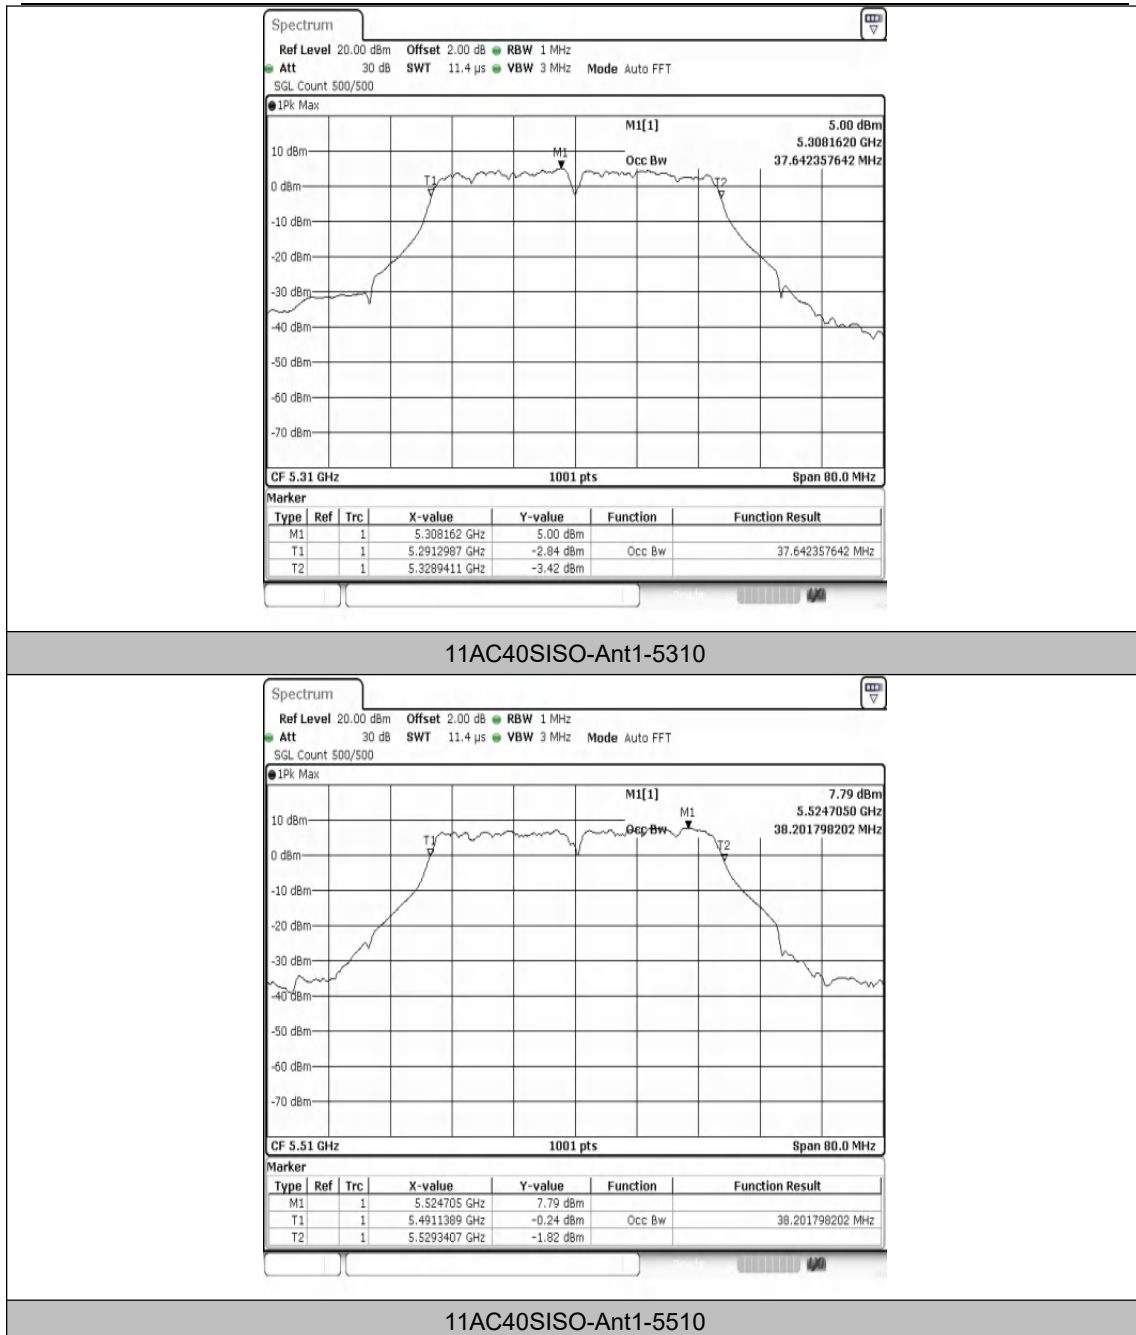

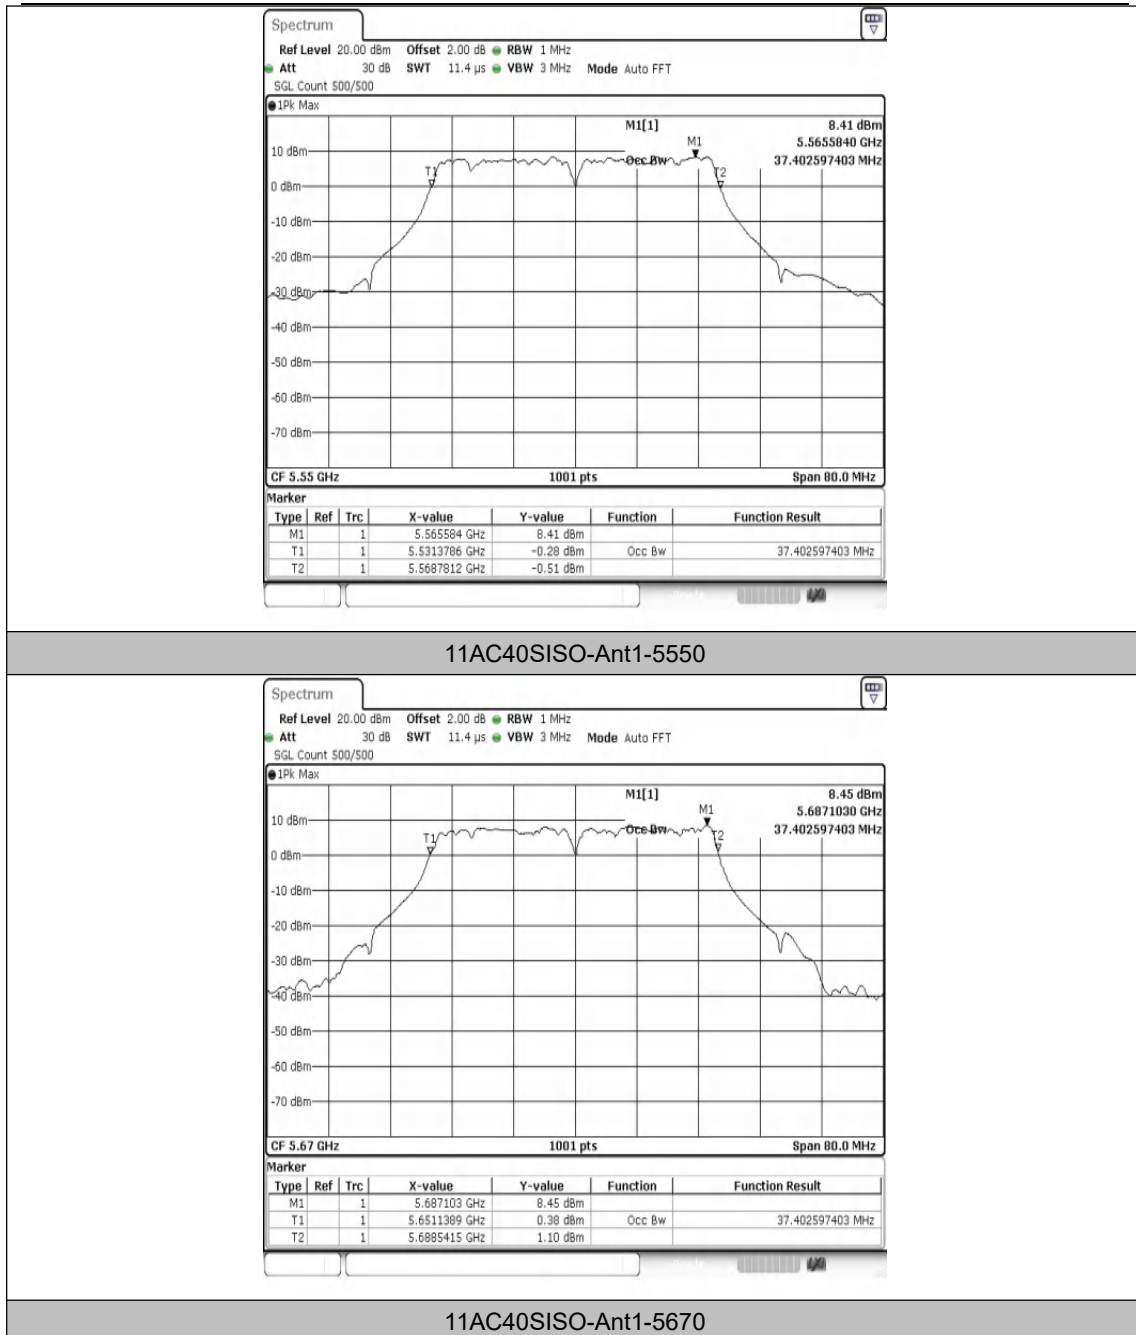

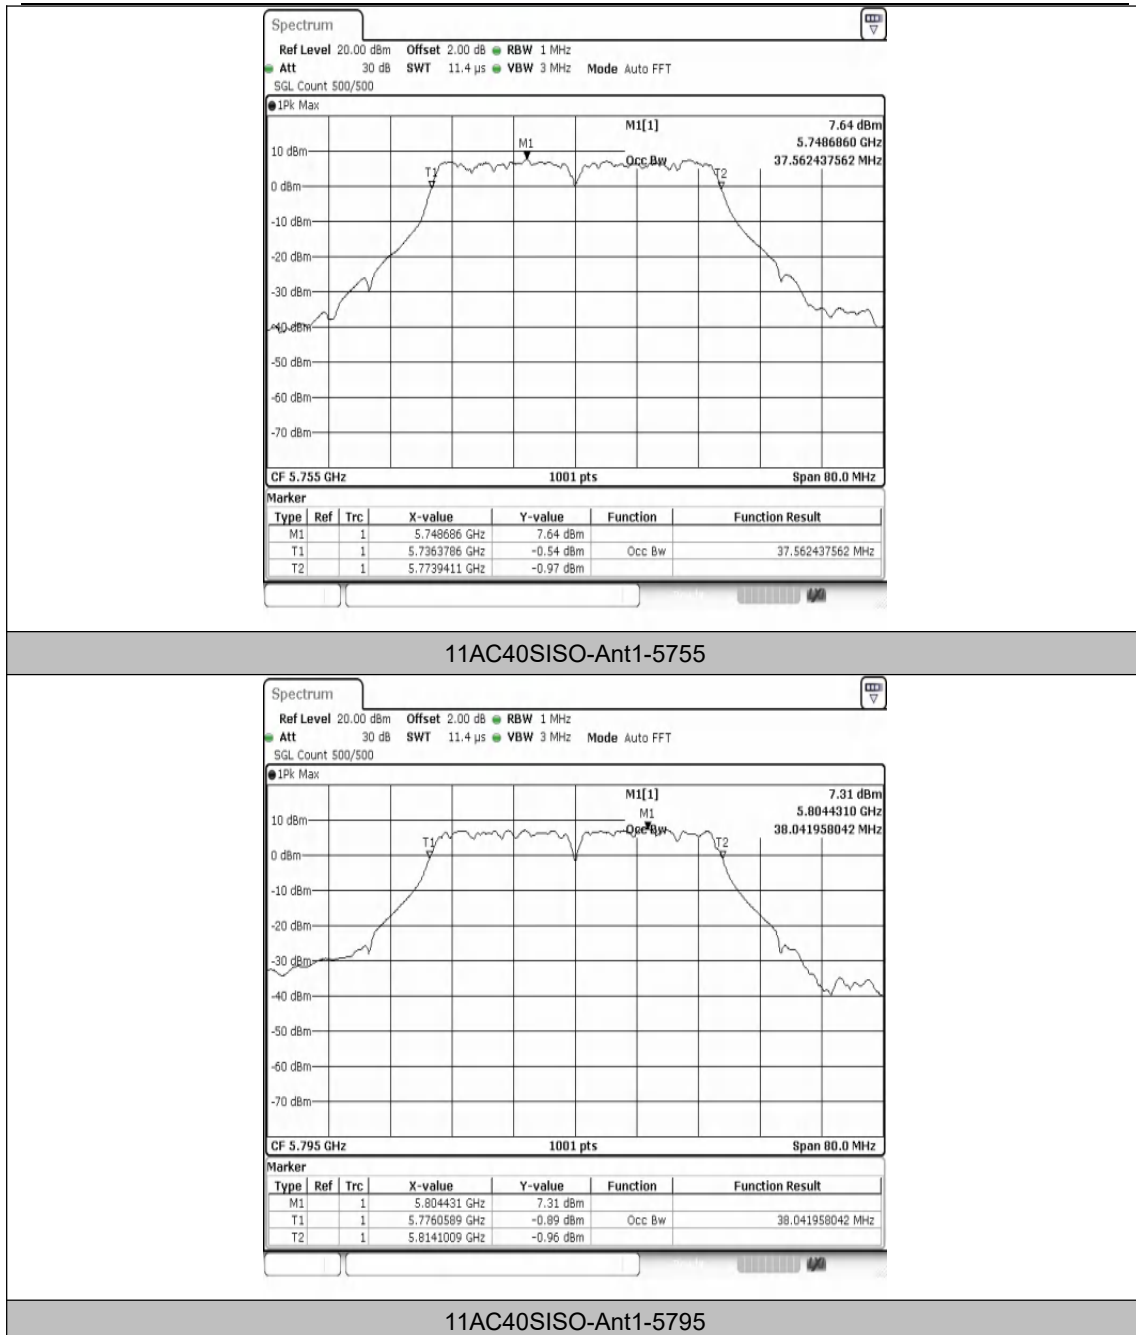


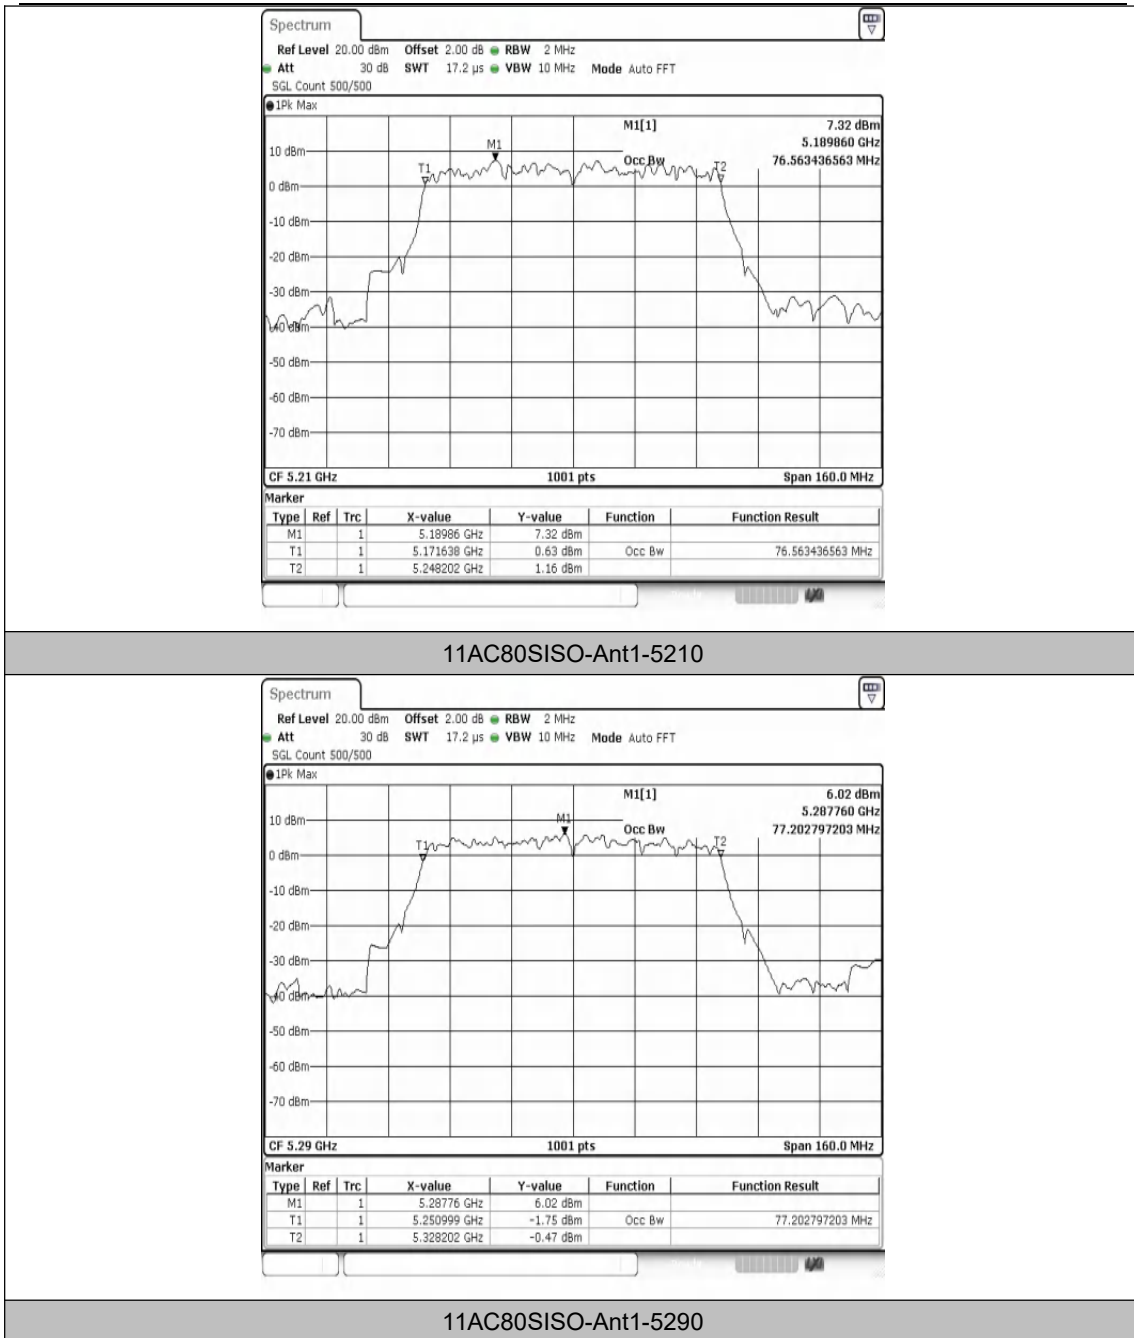


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

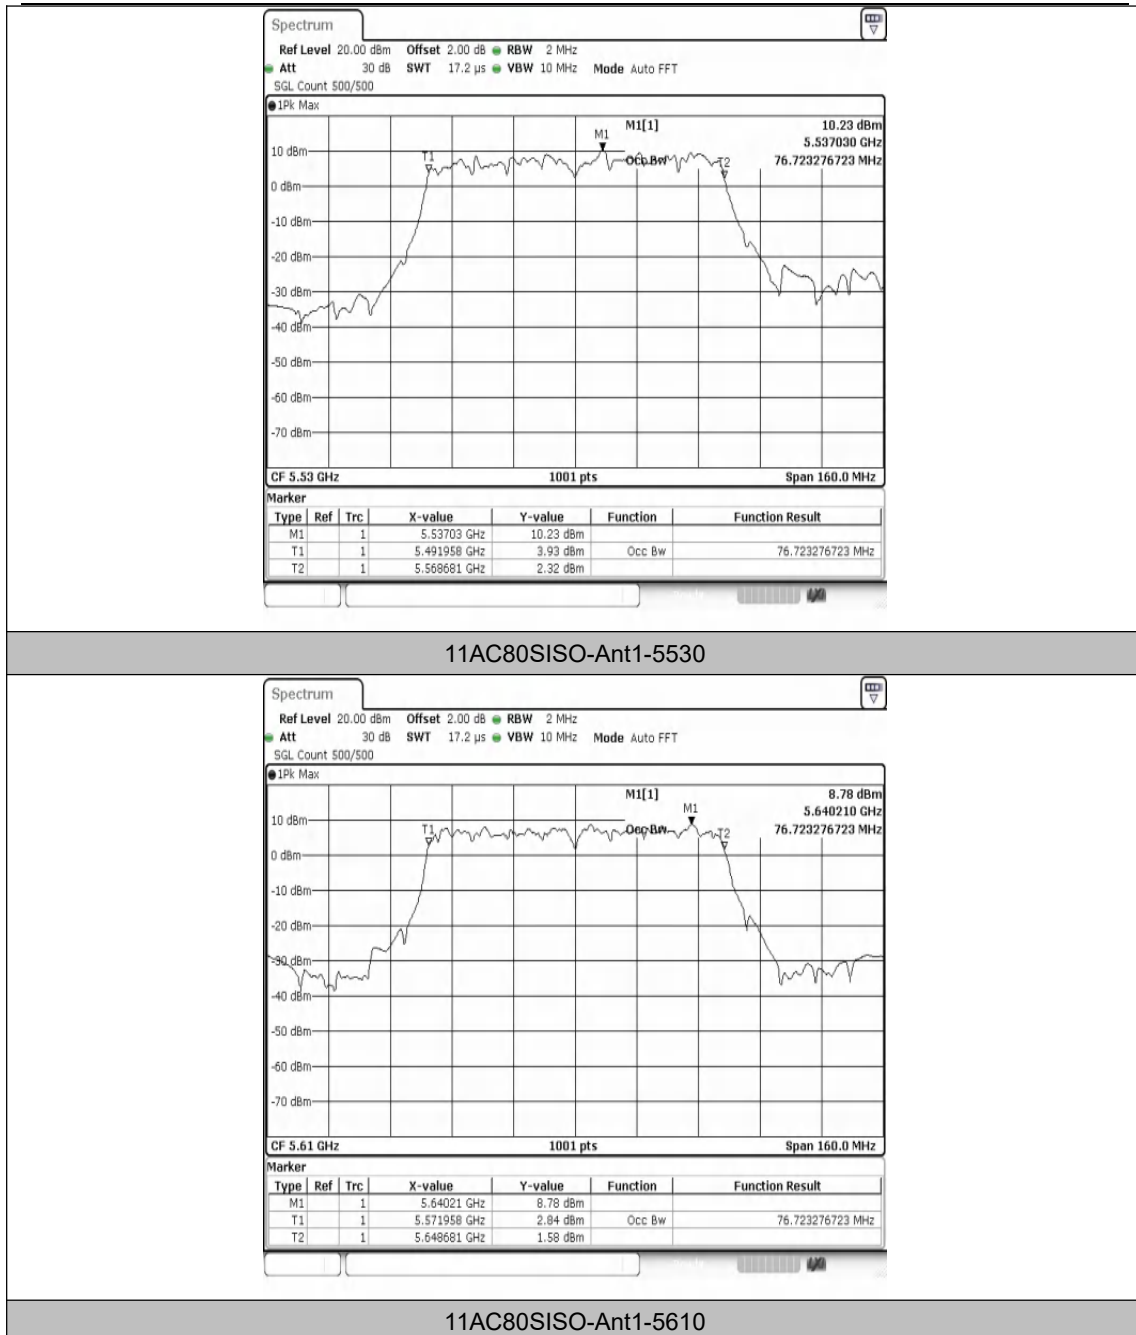


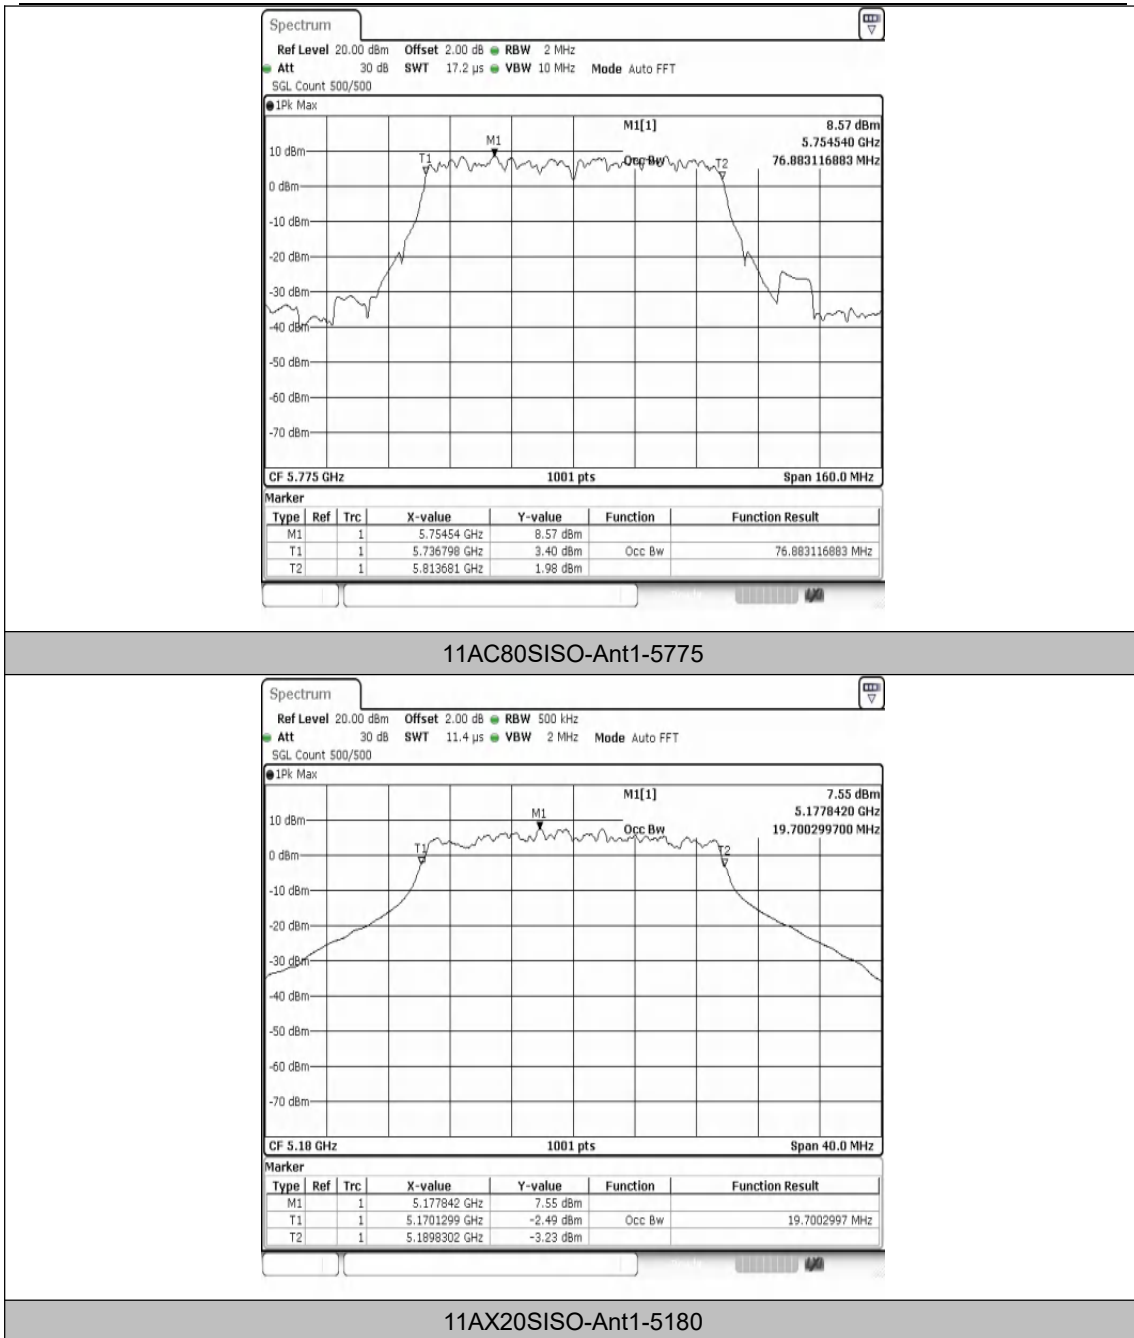



Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

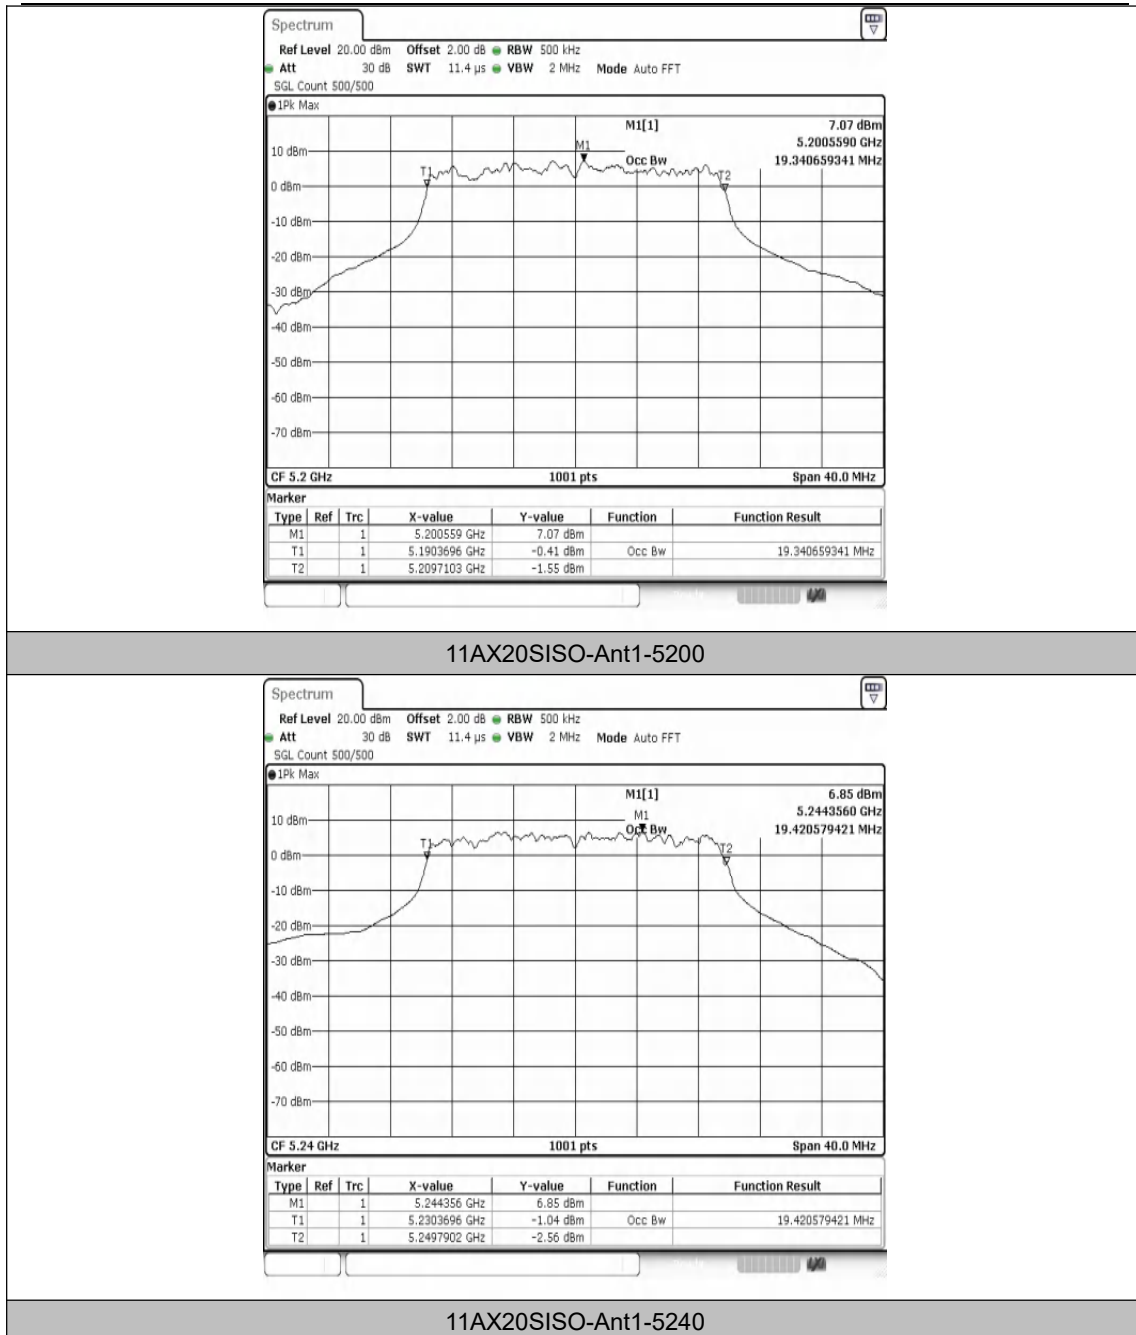

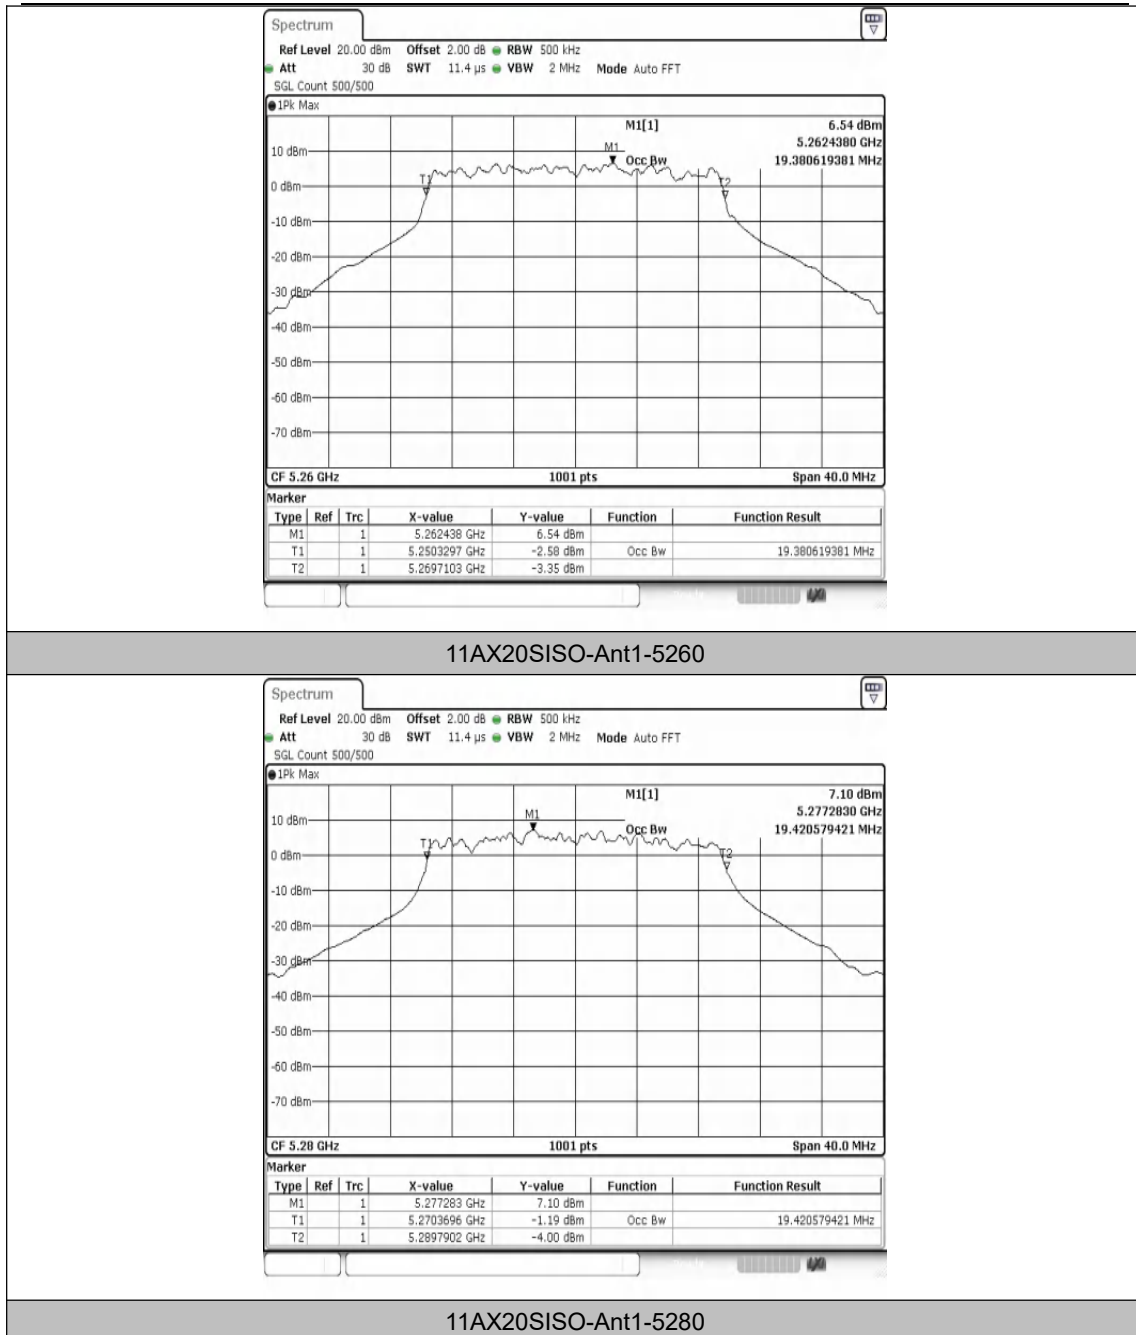


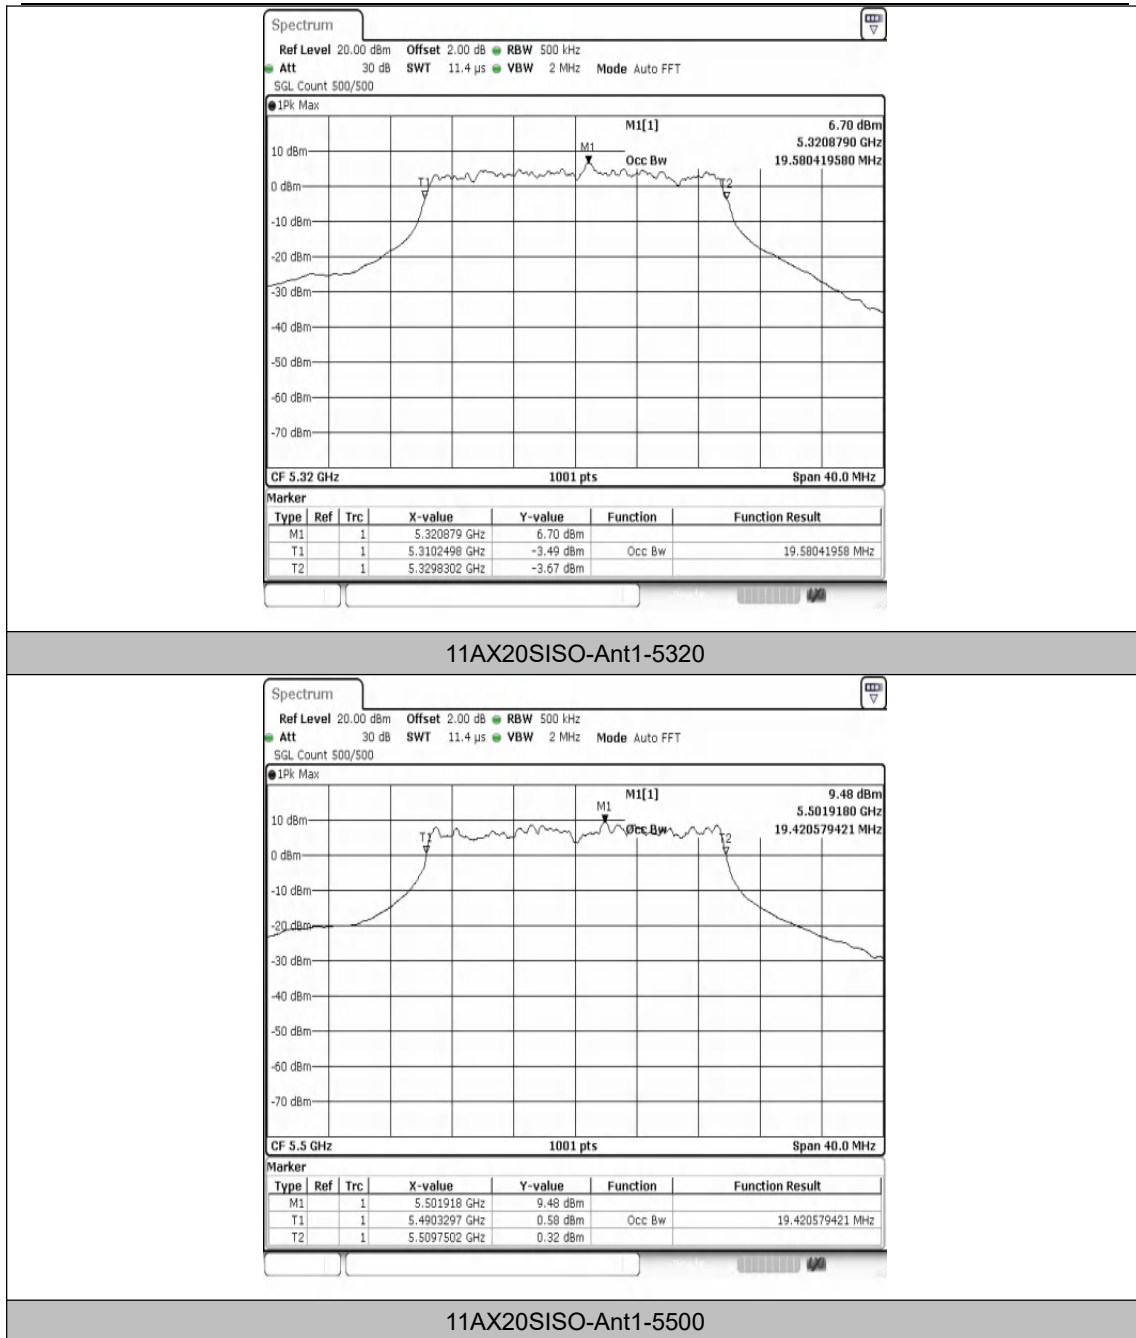

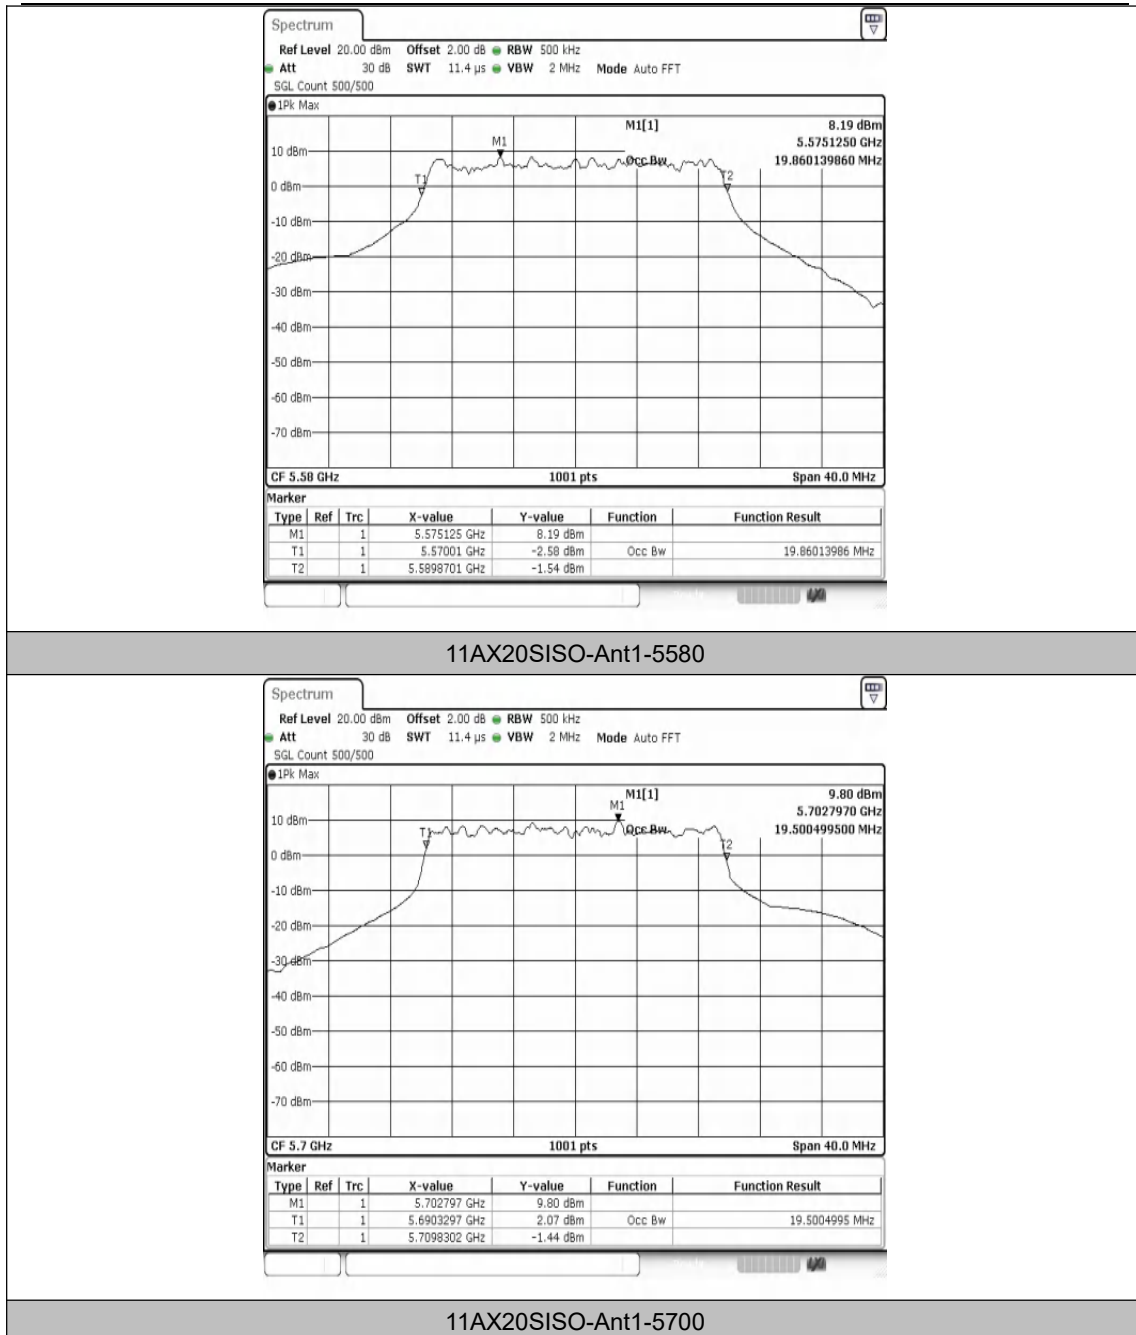


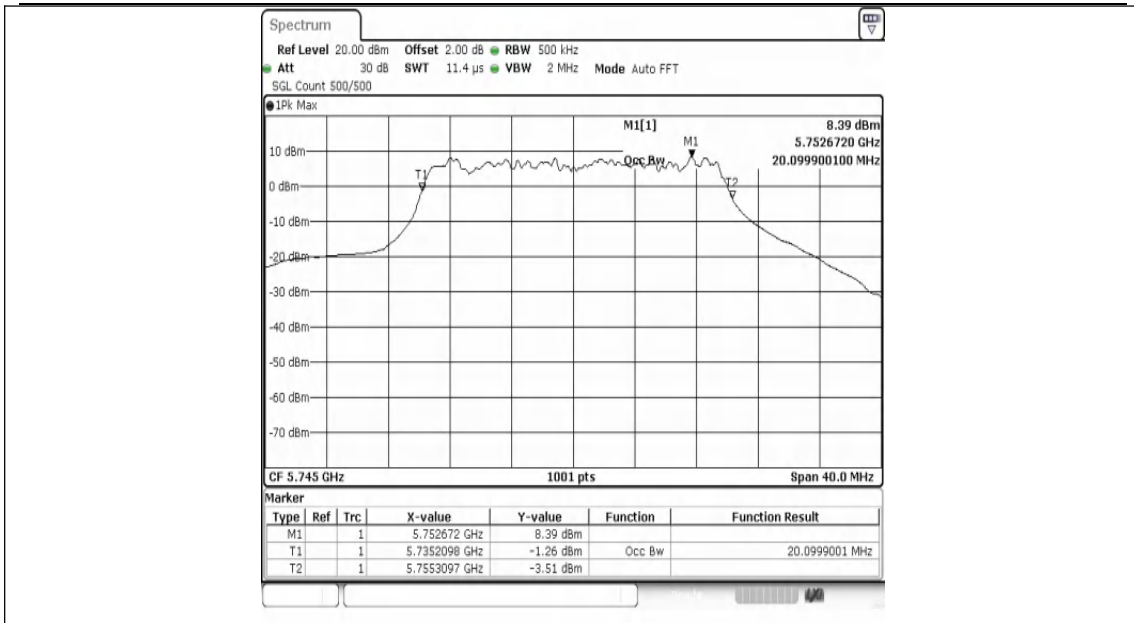



11AX20SISO-Ant1-5745

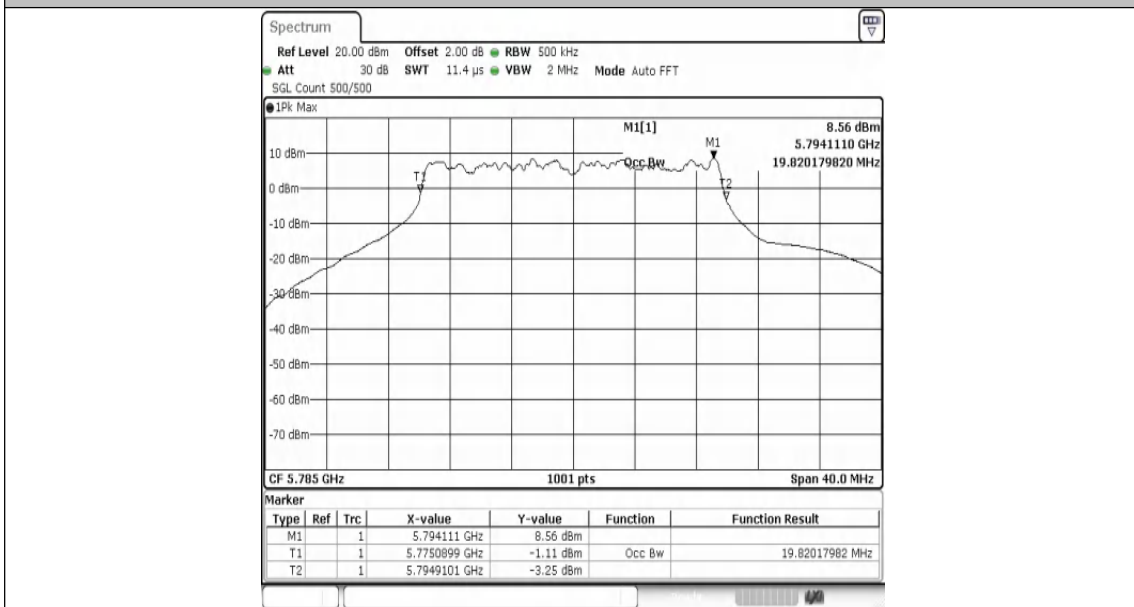



11AX20SISO-Ant1-5785

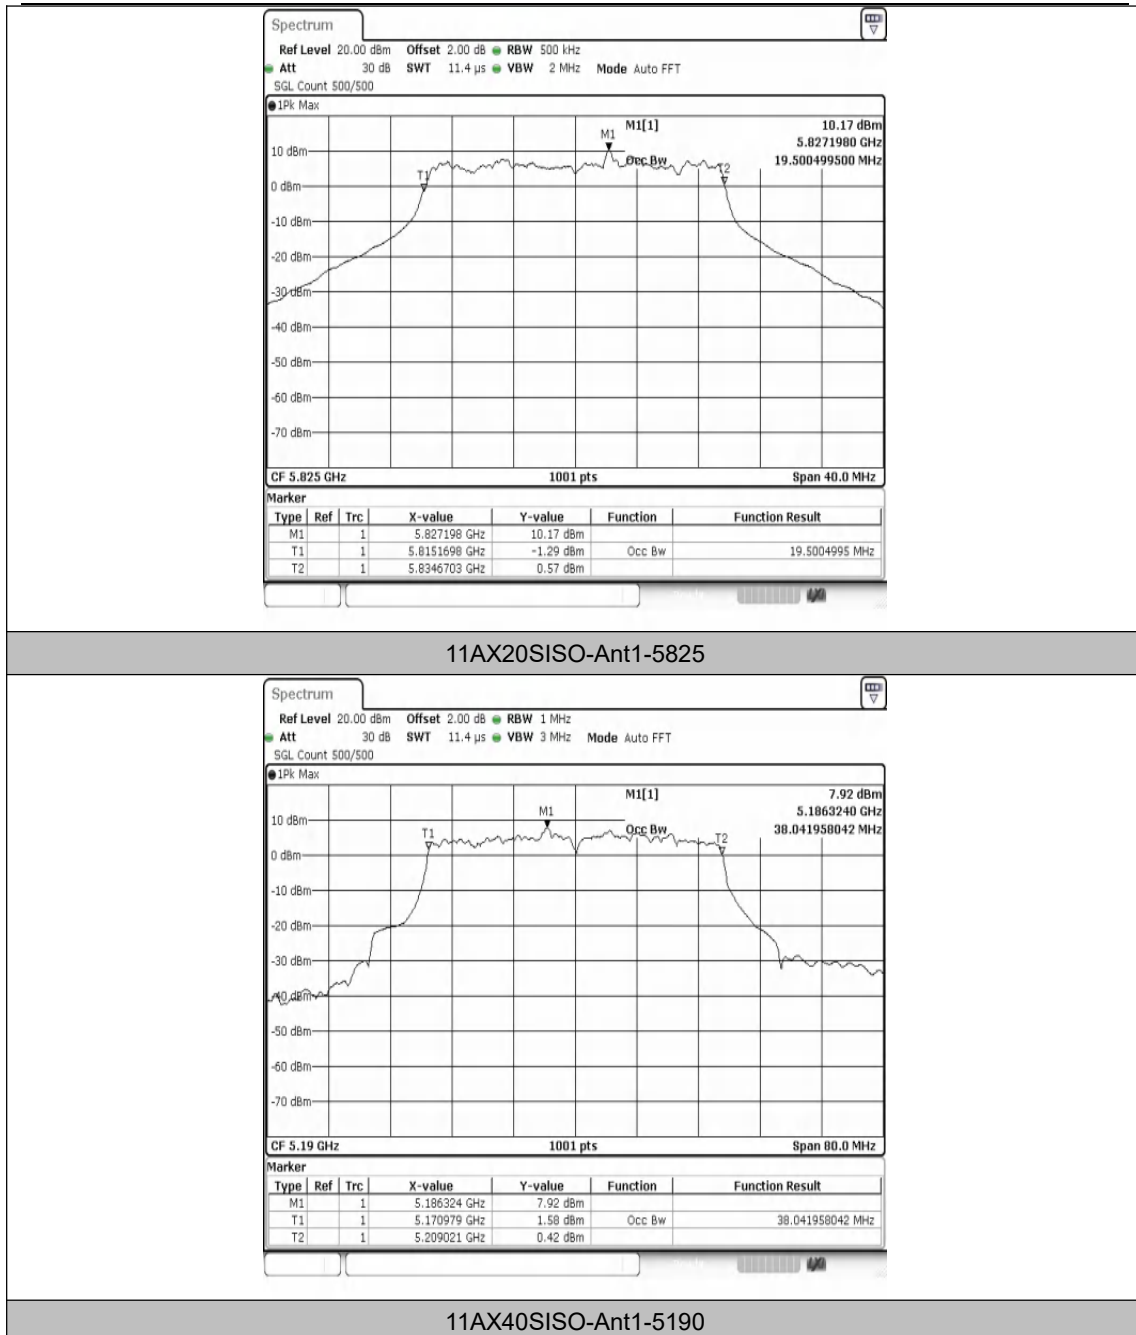

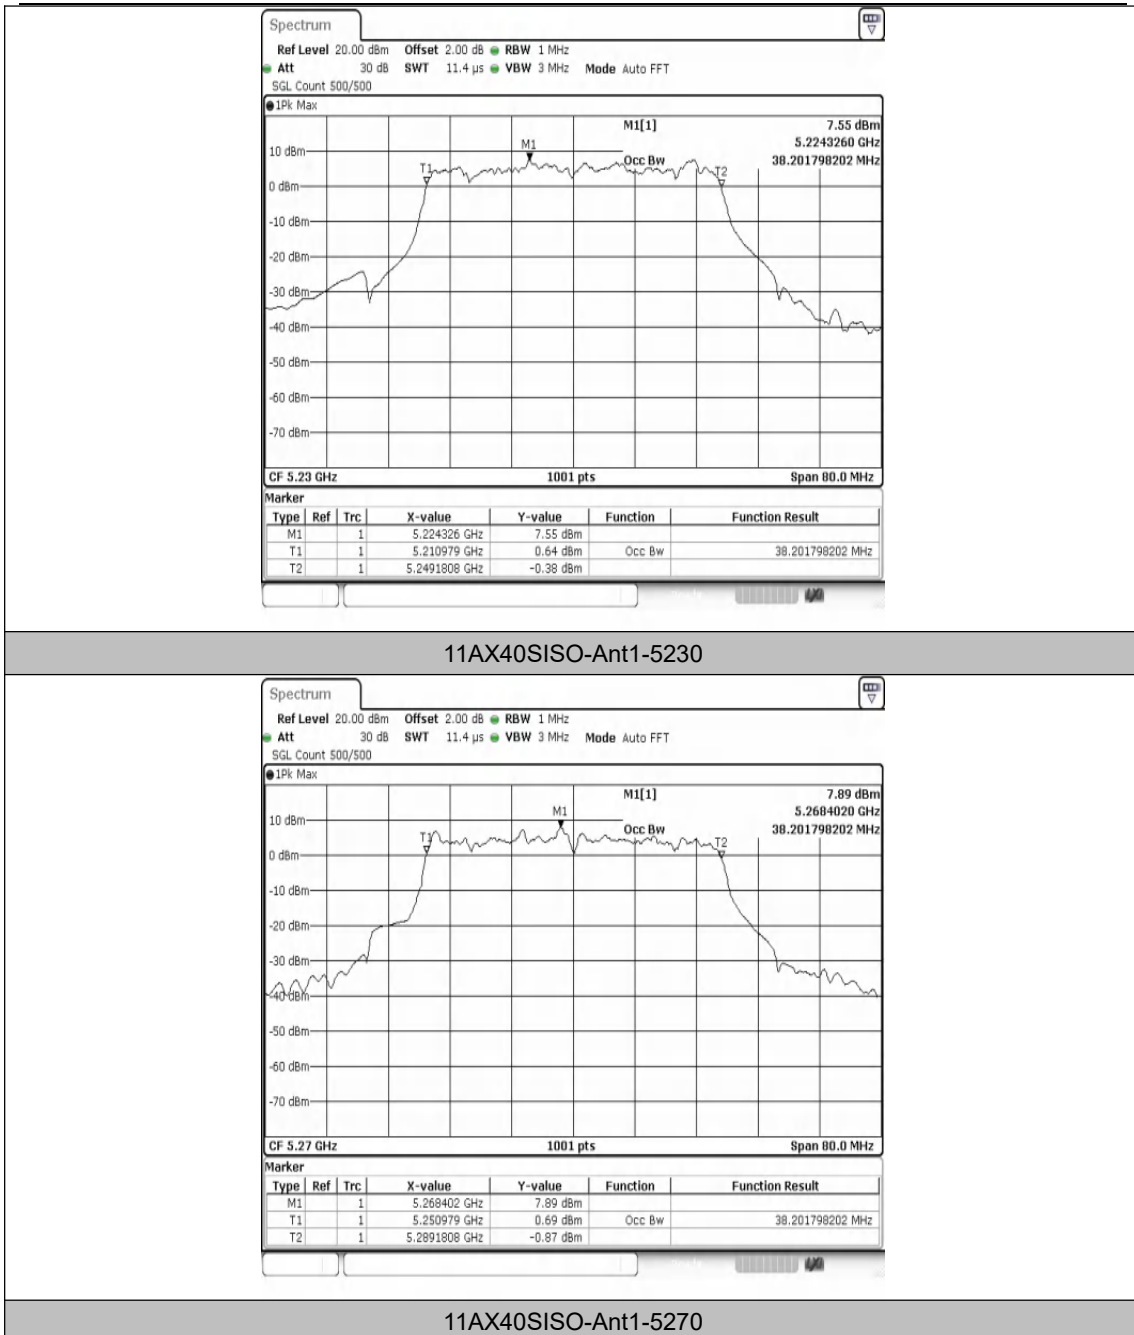

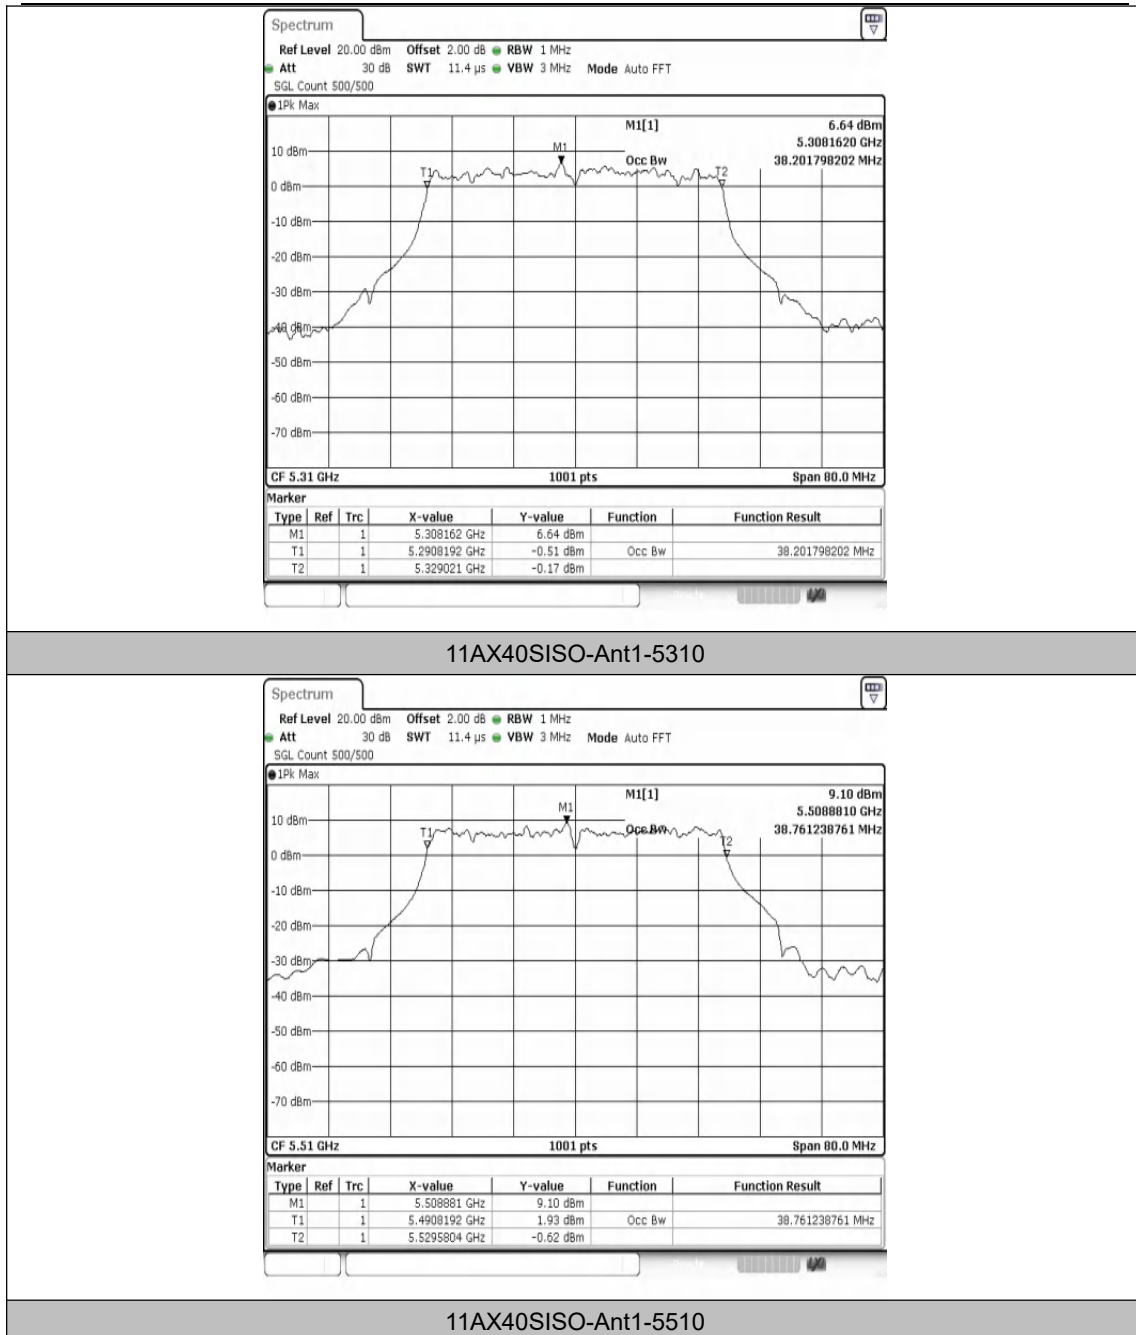

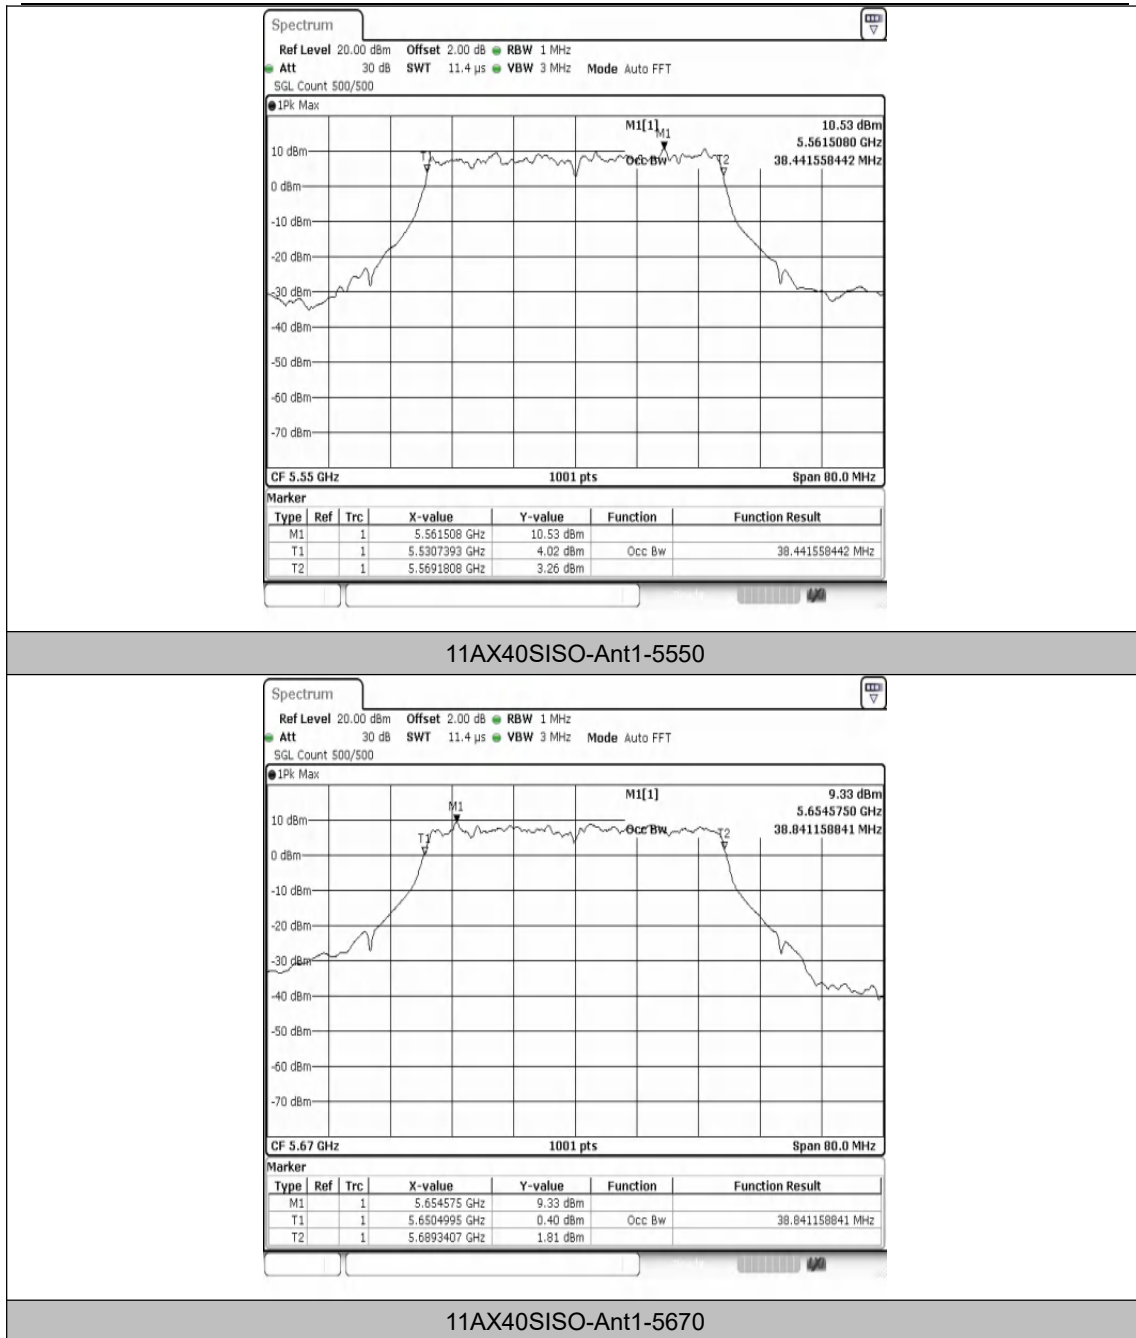


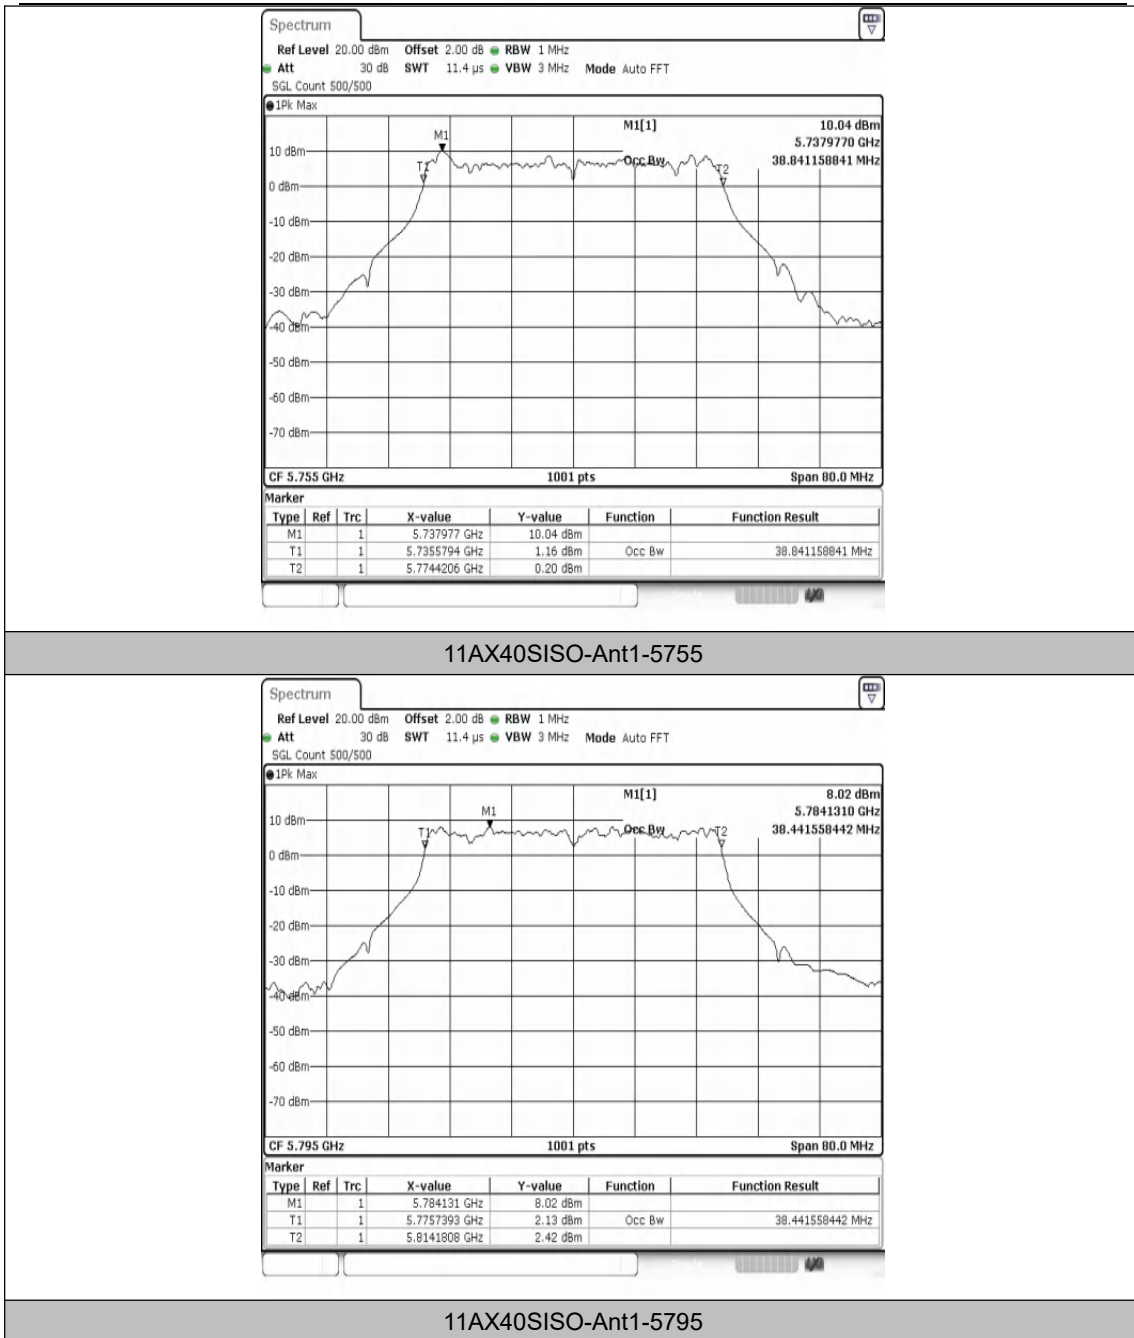



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

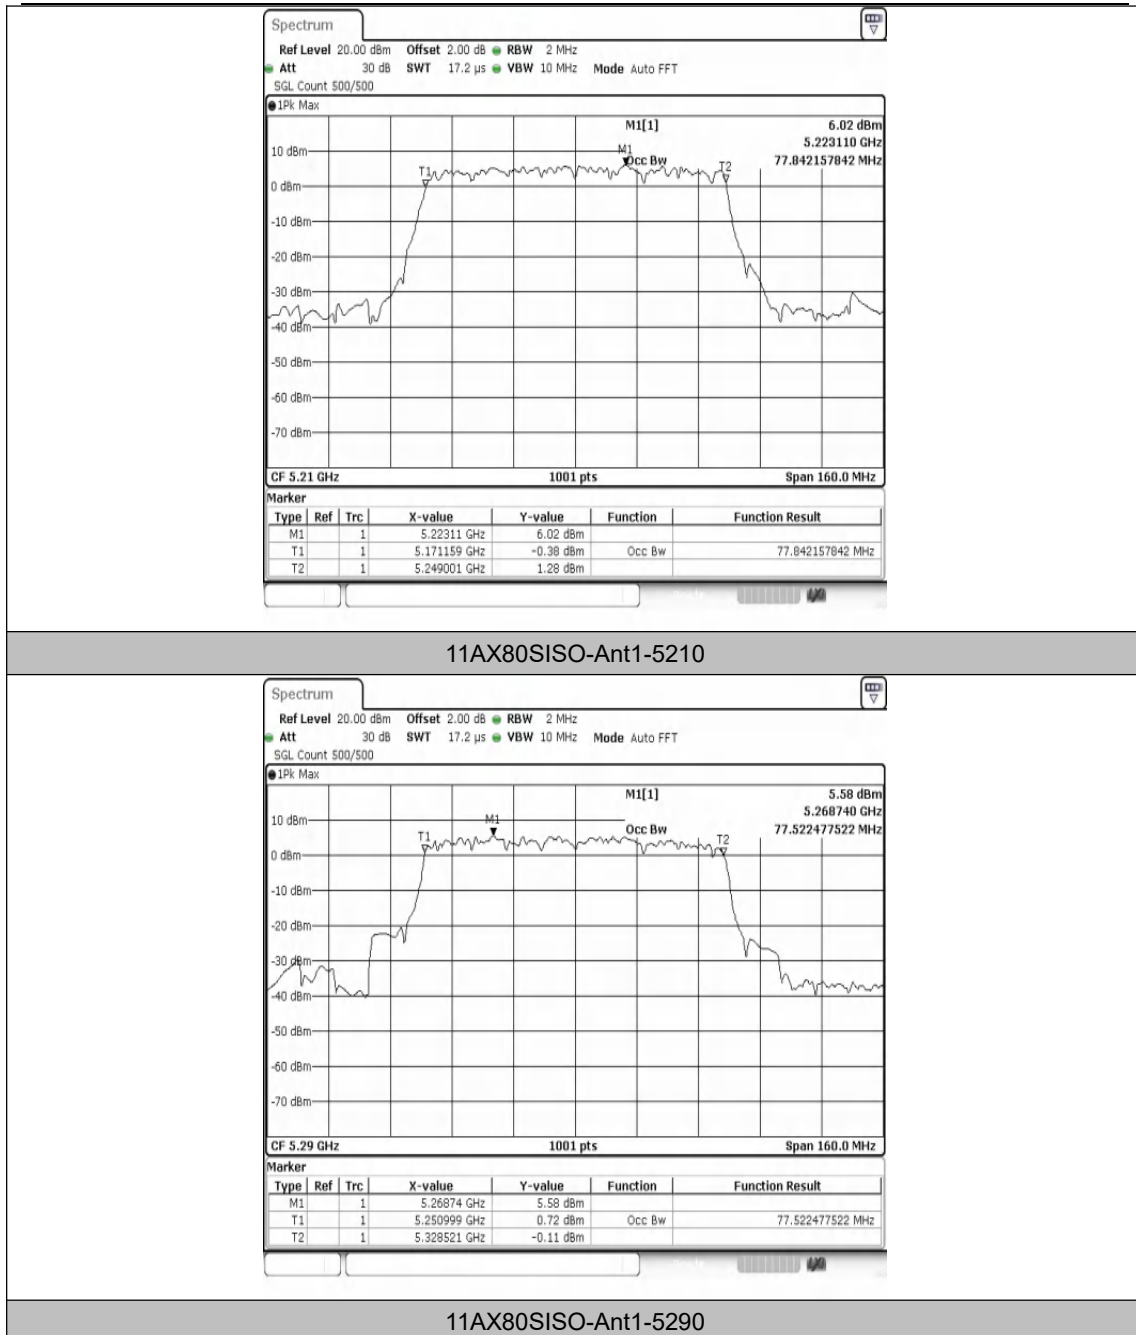

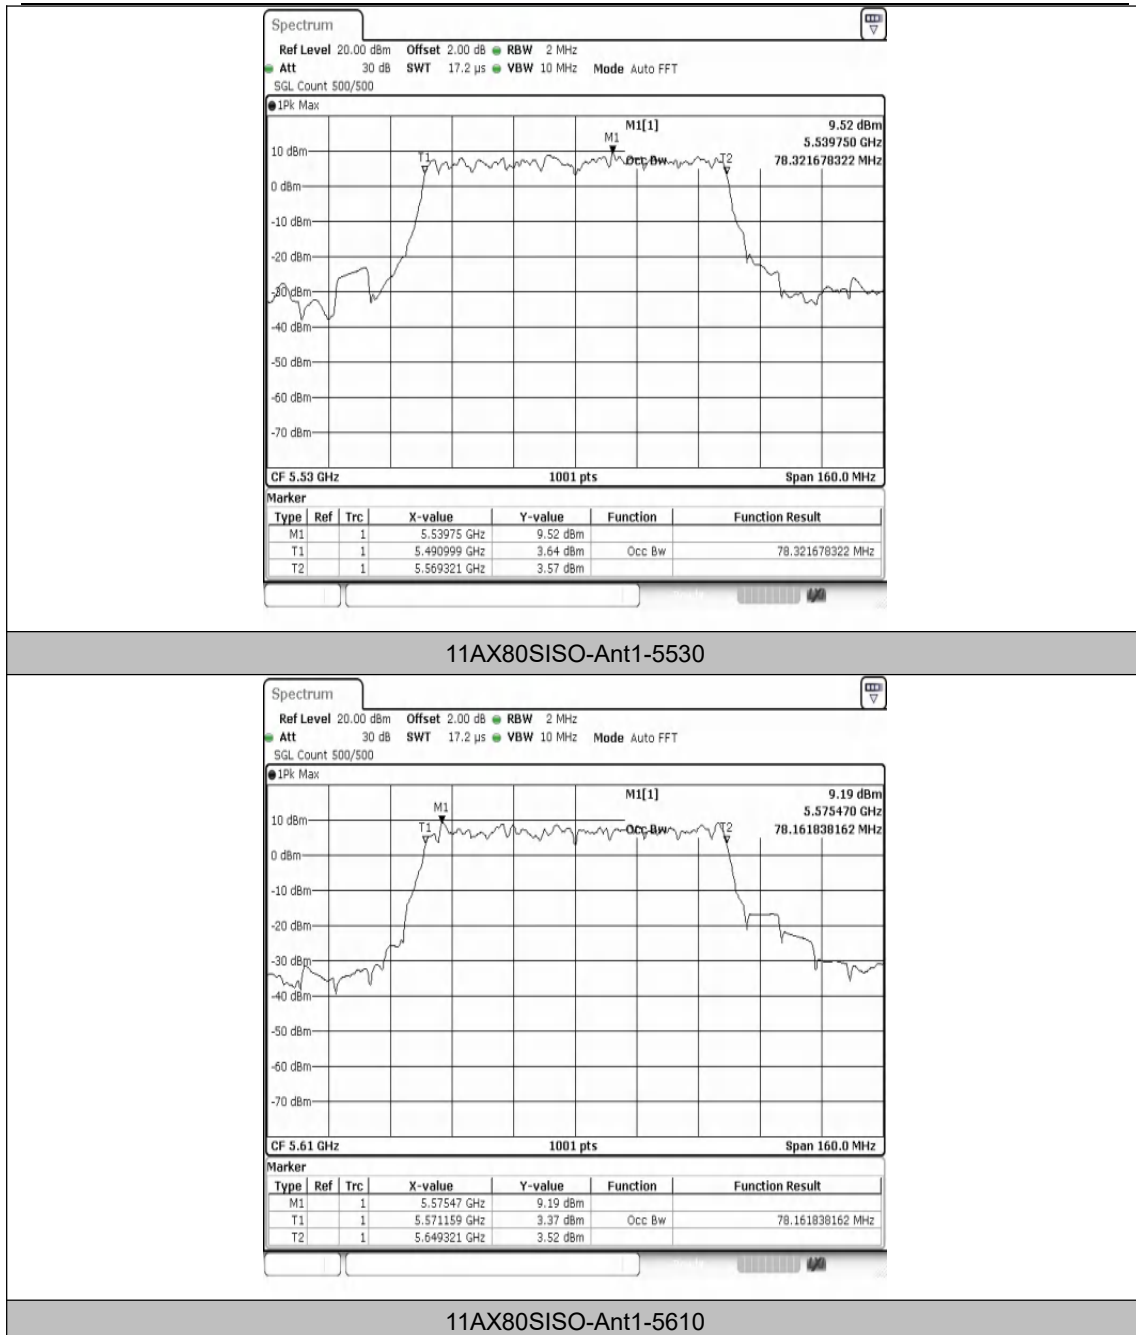

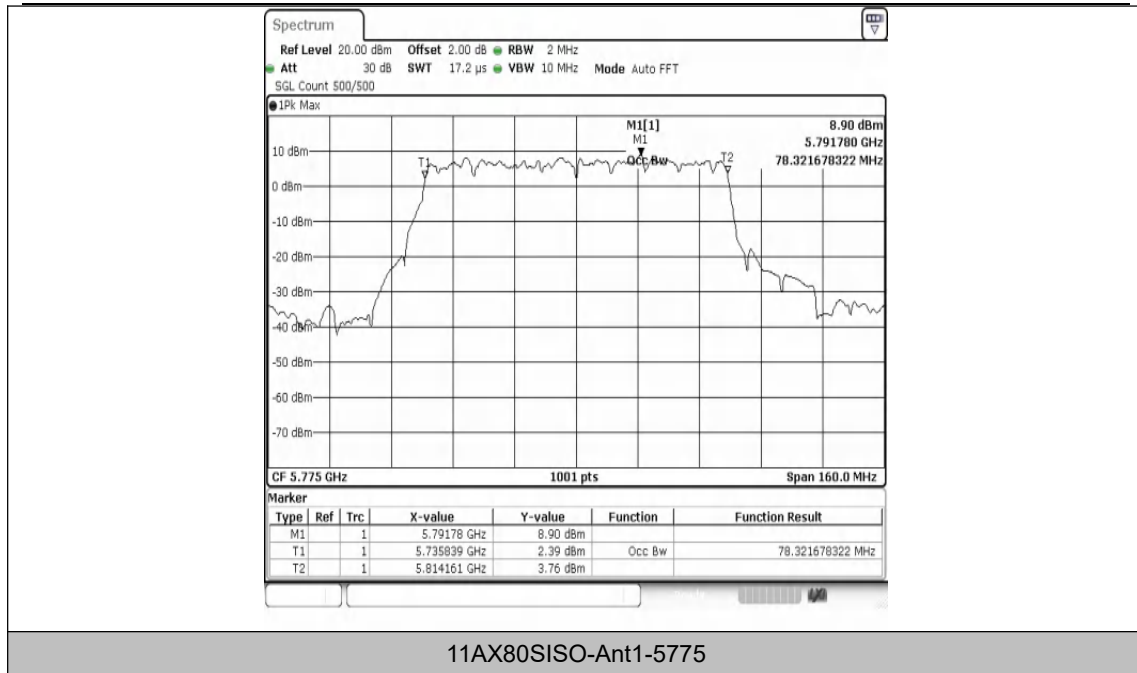

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com