

Appendix Test Data

Report No.:	1813C50436212502-01	Test Sample No.:	1-2-2
Start Test Date:	2025-10-14	Finish Test Date:	2025-10-21
Test Engineer:	<i>dylan. Ma</i>	Auditor:	<i>Justin Feng</i>
Temperature:	22.0°C	Relative Humidity:	53%
Pressure:	101kPa		




Appendix A: 6dB Bandwidth

Test Result

Test Mode	Antenna	Frequency[MHz]	6dB BW [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11B	Ant1	2412	10.20	2406.92	2417.12	0.5	PASS
11B	Ant1	2437	10.16	2431.96	2442.12	0.5	PASS
11B	Ant1	2462	10.16	2456.96	2467.12	0.5	PASS
11G	Ant1	2412	16.08	2403.96	2420.04	0.5	PASS
11G	Ant1	2437	16.40	2428.76	2445.16	0.5	PASS
11G	Ant1	2462	16.32	2453.88	2470.20	0.5	PASS
11N20SISO	Ant1	2412	17.64	2403.16	2420.8	0.5	PASS
11N20SISO	Ant1	2437	17.48	2428.28	2445.76	0.5	PASS
11N20SISO	Ant1	2462	17.40	2453.36	2470.76	0.5	PASS
11N40SISO	Ant1	2422	35.84	2403.92	2439.76	0.5	PASS
11N40SISO	Ant1	2437	36.24	2418.84	2455.08	0.5	PASS
11N40SISO	Ant1	2452	36.08	2433.92	2470.00	0.5	PASS
11AX20SISO	Ant1	2412	18.88	2402.56	2421.44	0.5	PASS
11AX20SISO	Ant1	2437	18.96	2427.56	2446.52	0.5	PASS
11AX20SISO	Ant1	2462	18.88	2452.48	2471.36	0.5	PASS
11AX40SISO	Ant1	2422	36.64	2403.68	2440.32	0.5	PASS
11AX40SISO	Ant1	2437	36.80	2418.60	2455.40	0.5	PASS
11AX40SISO	Ant1	2452	37.76	2433.36	2471.12	0.5	PASS


Test Graphs

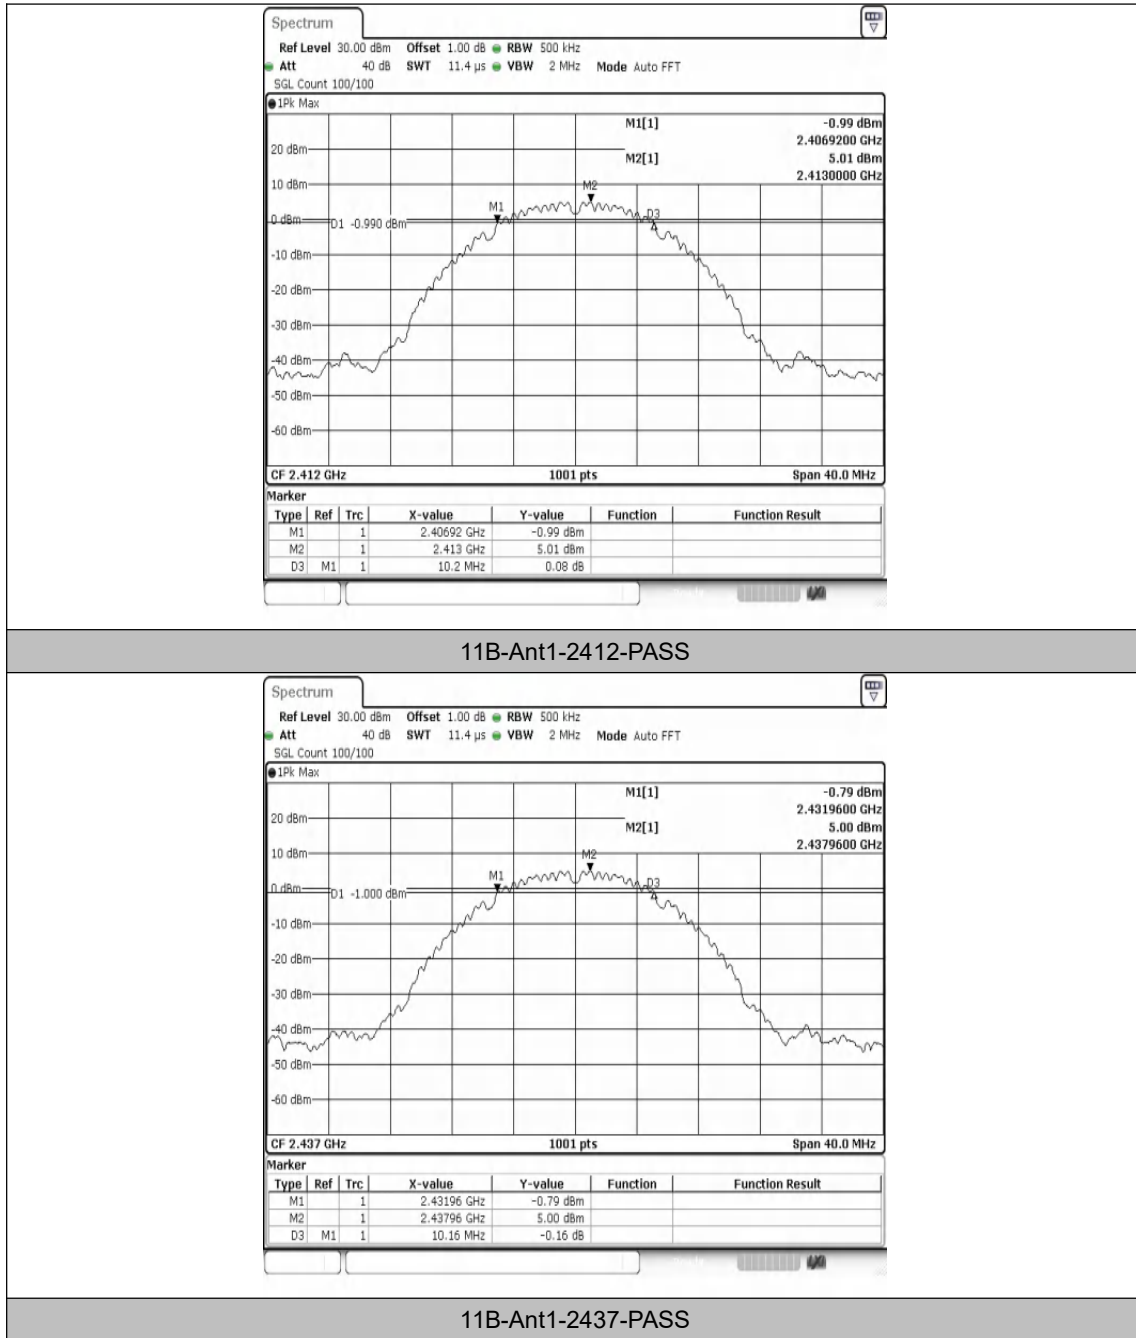

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

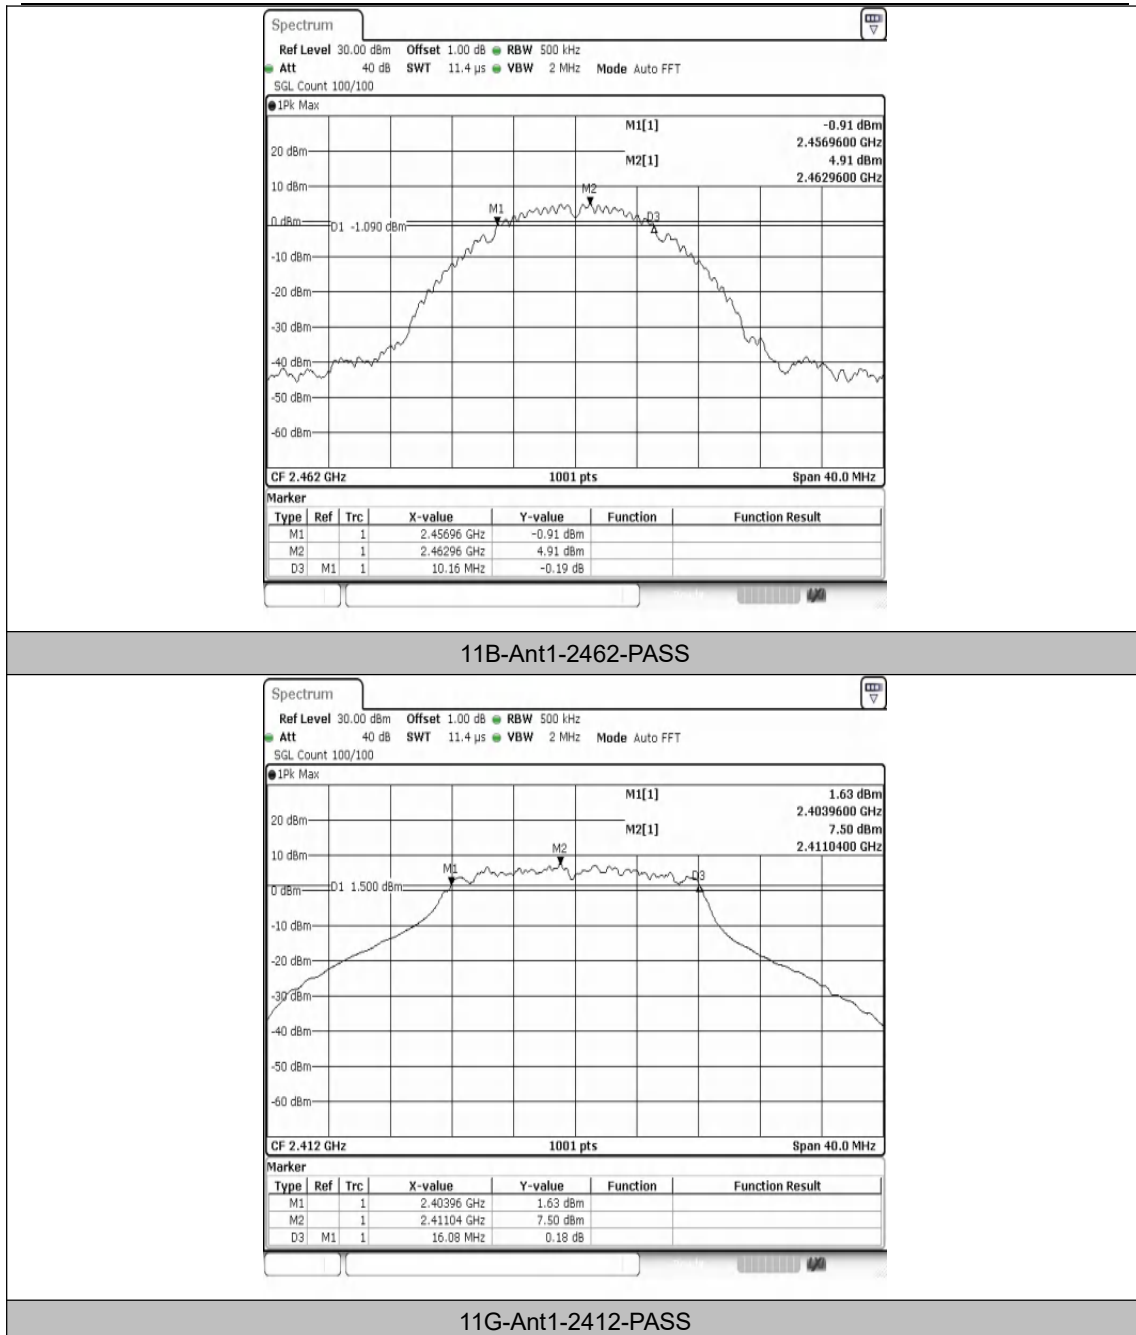

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

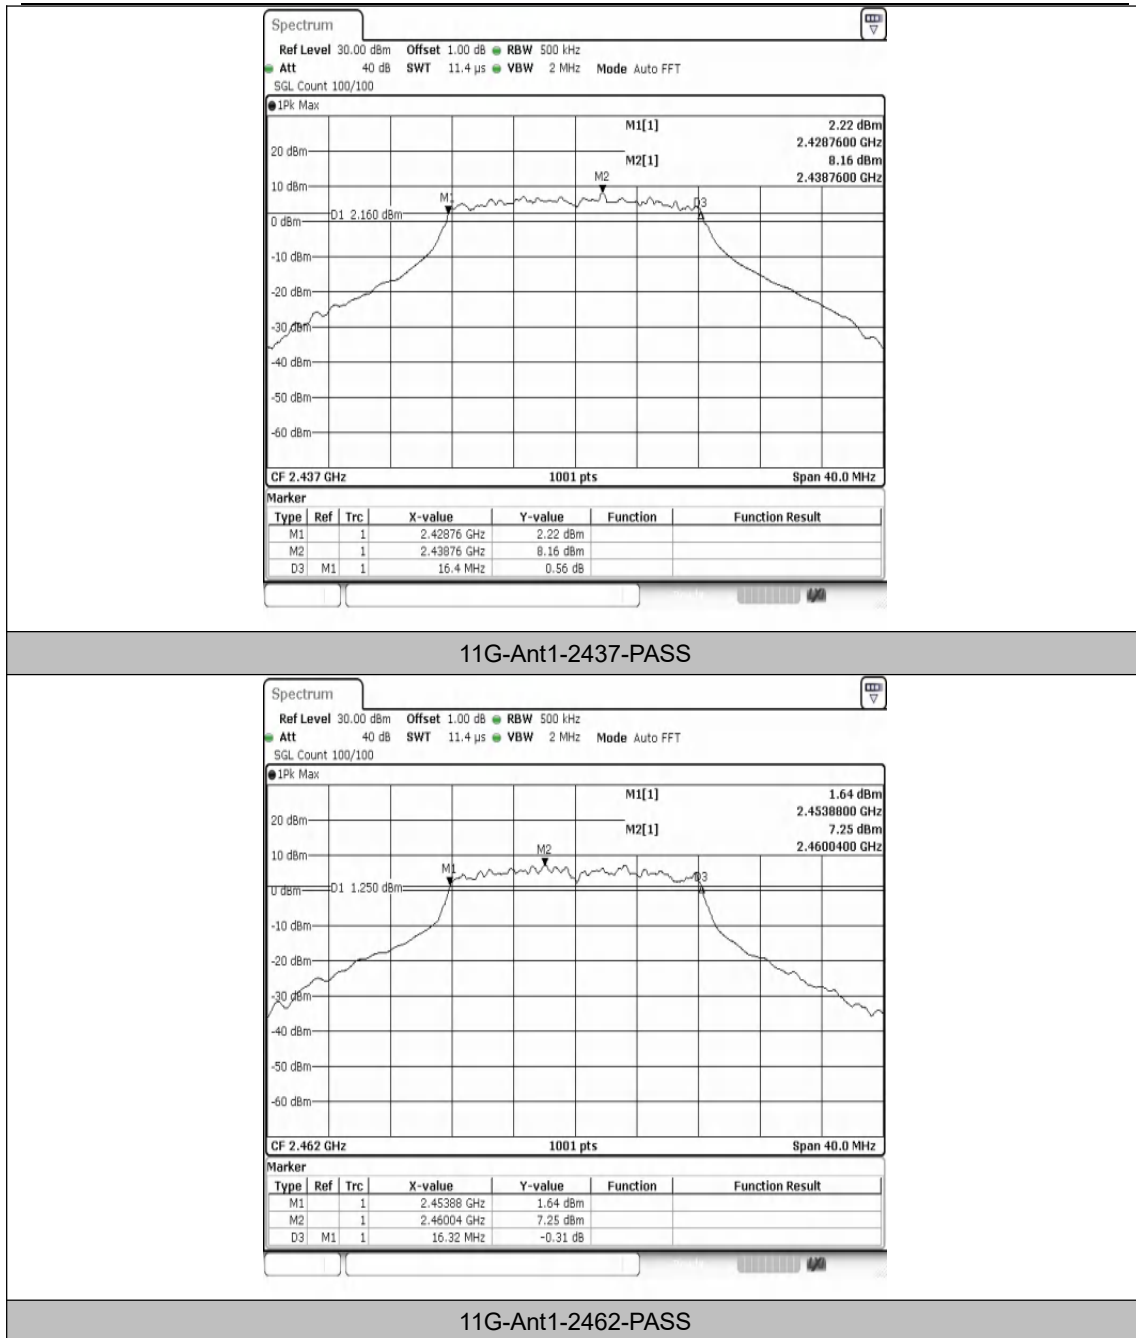

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

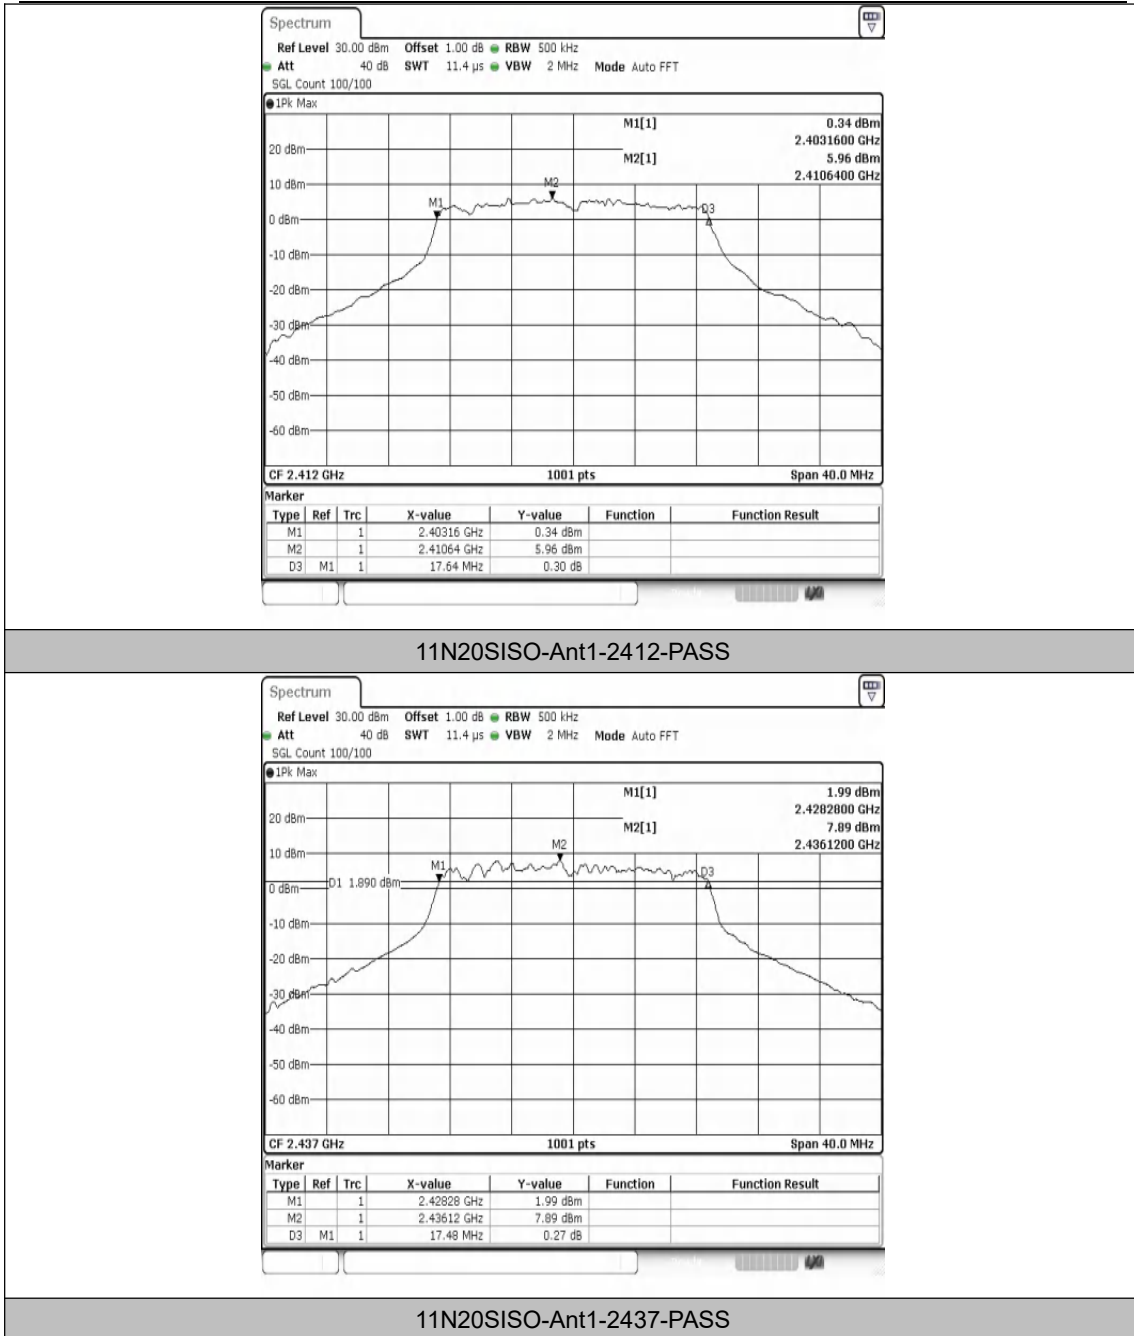

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

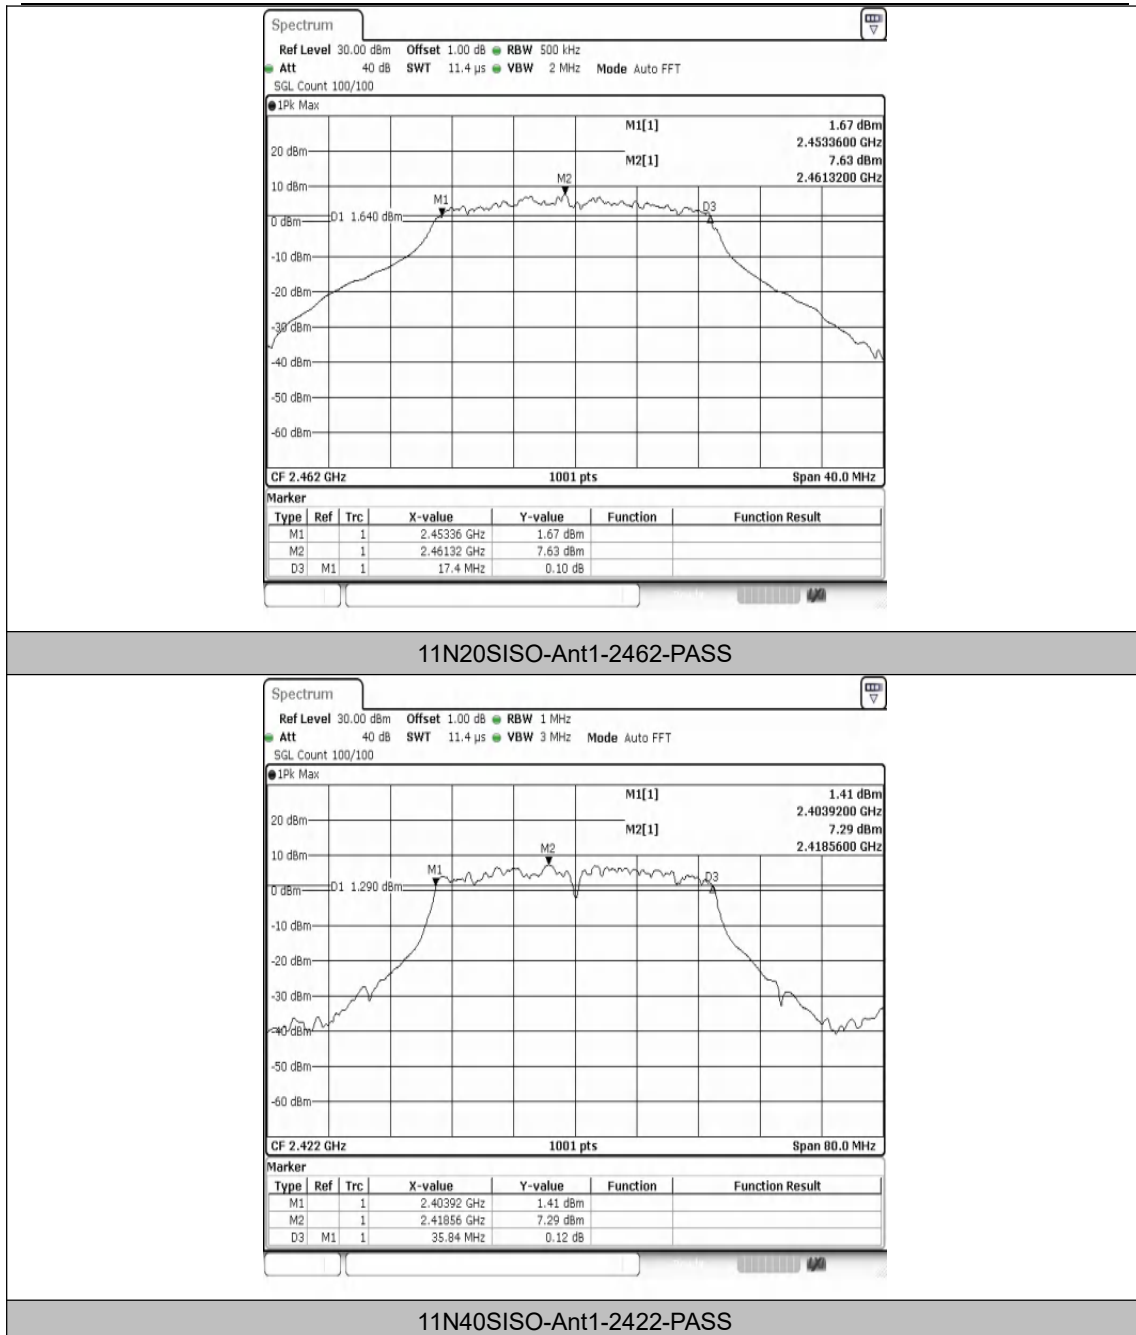


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

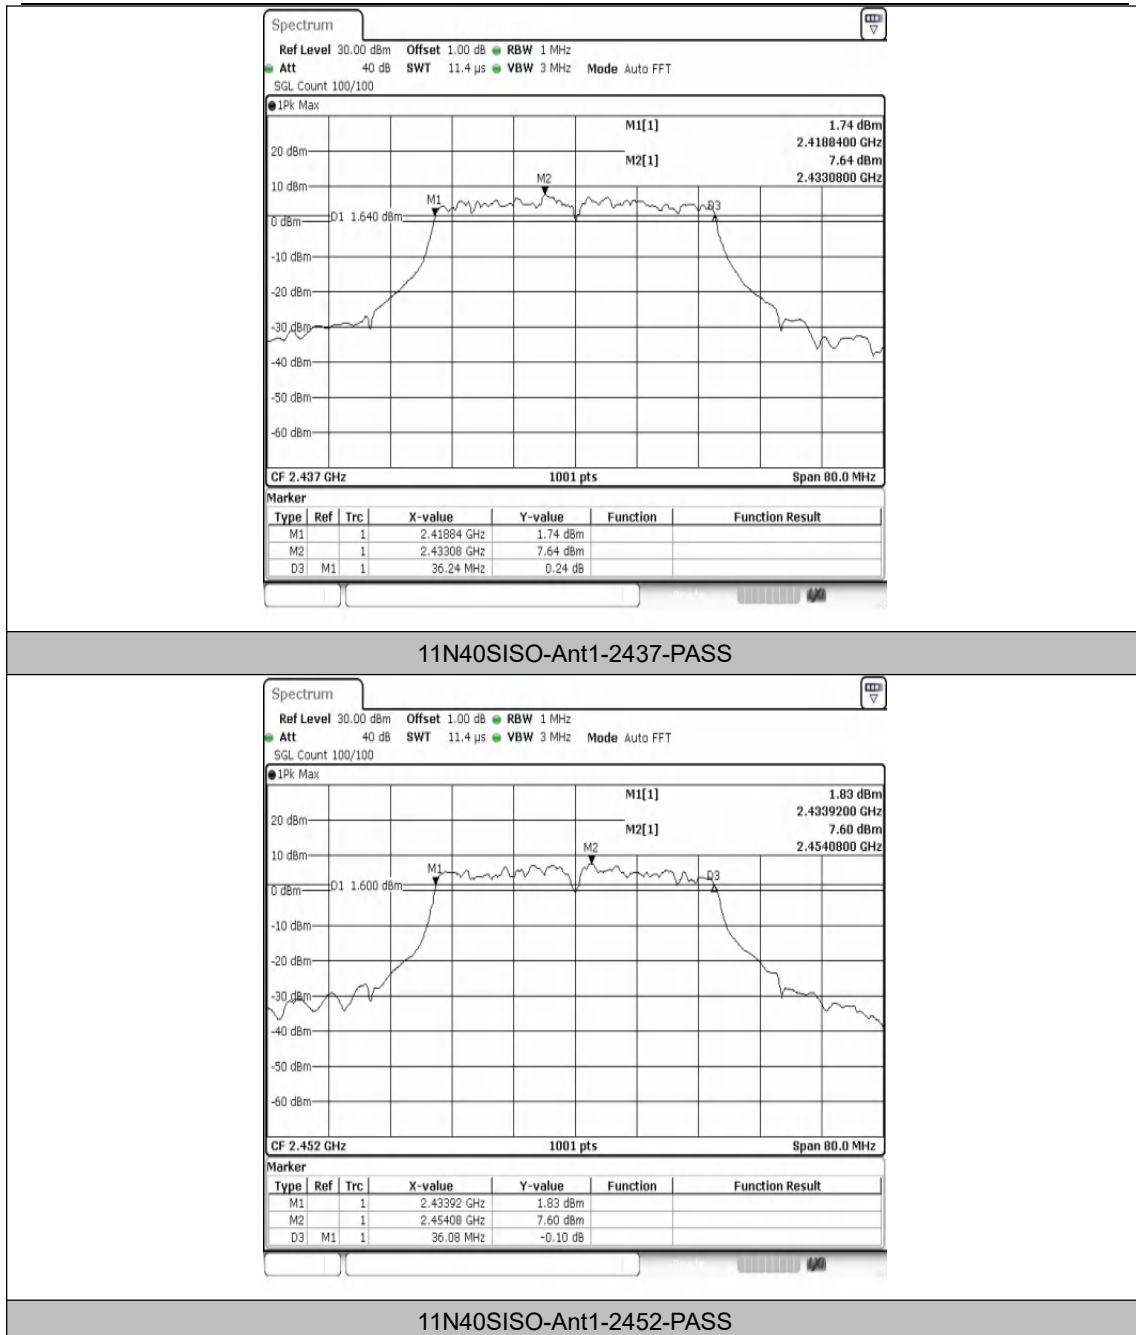


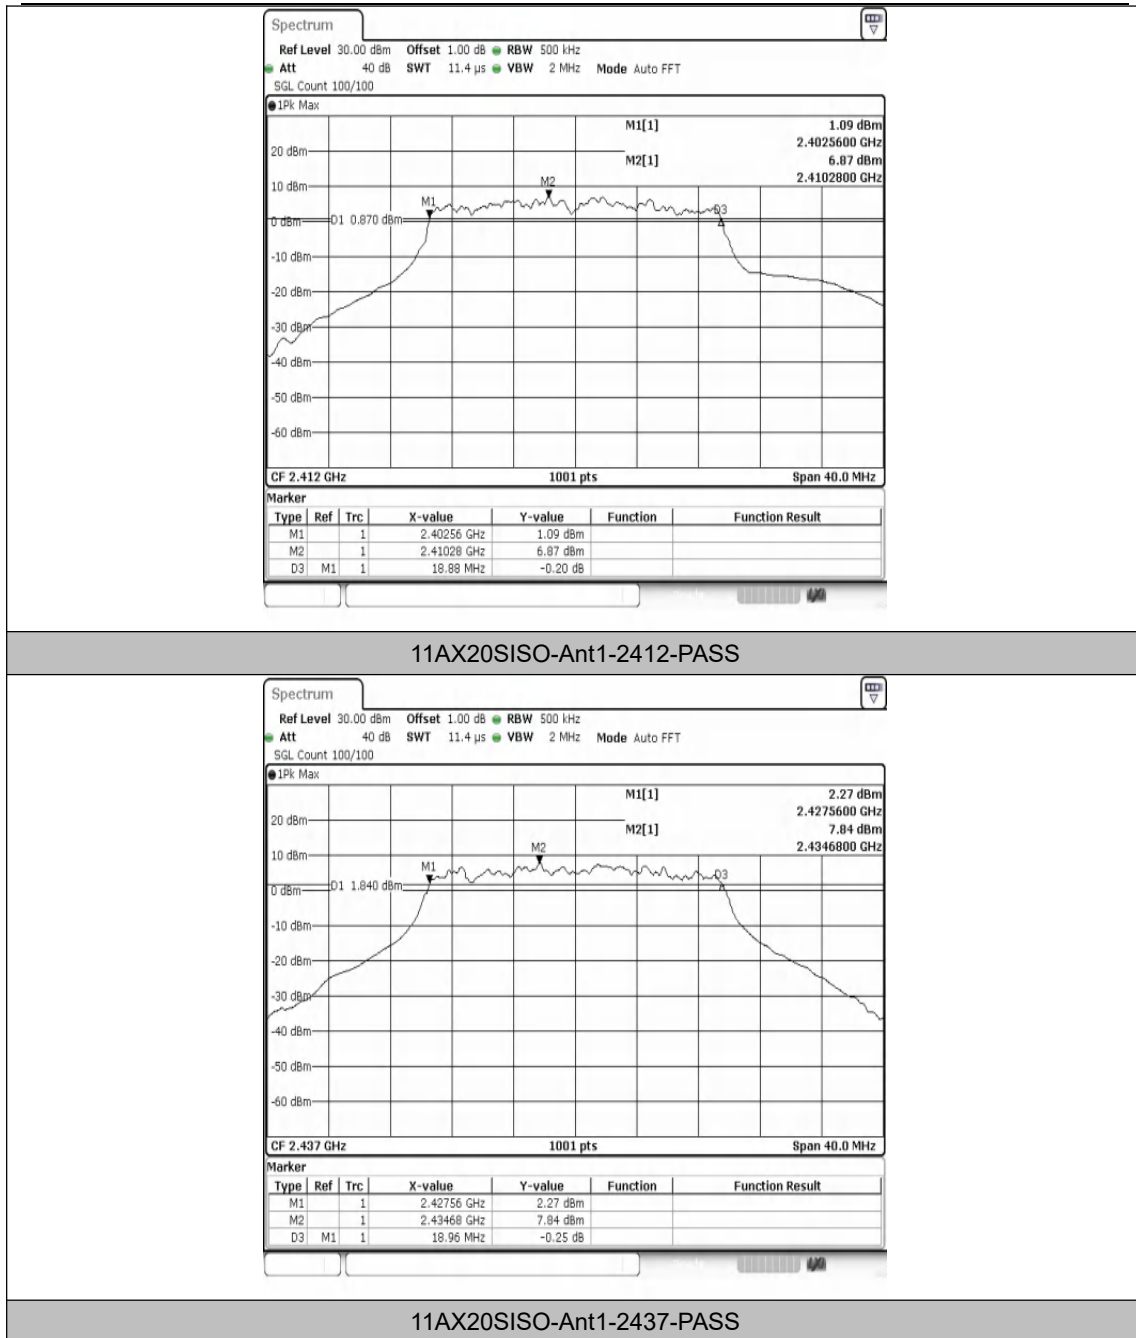


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

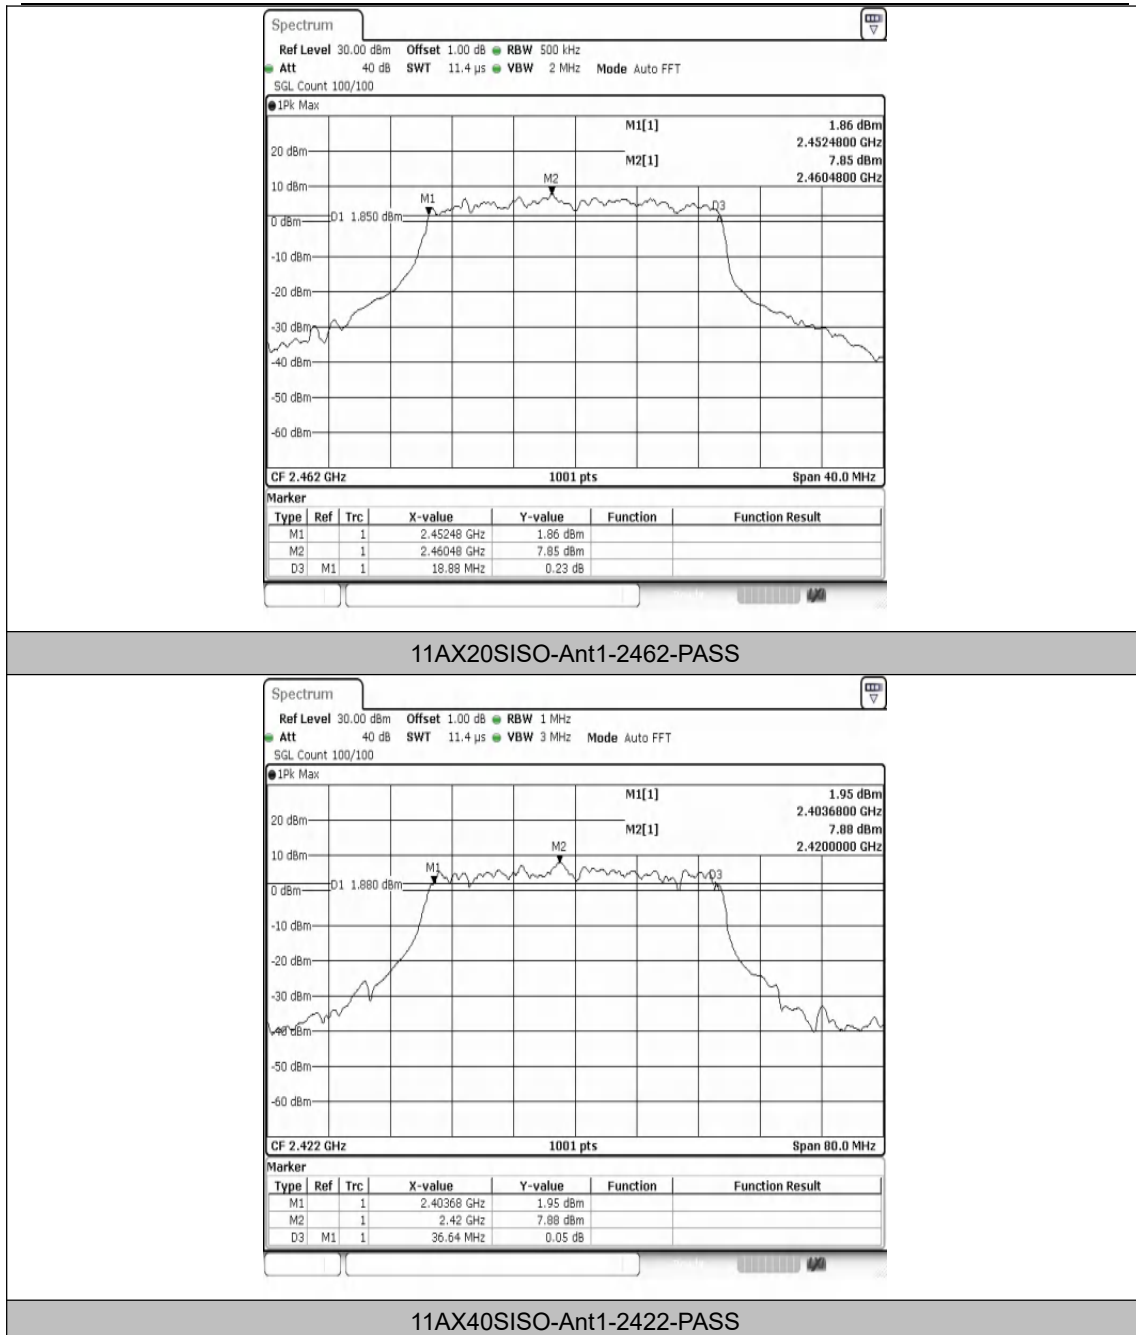

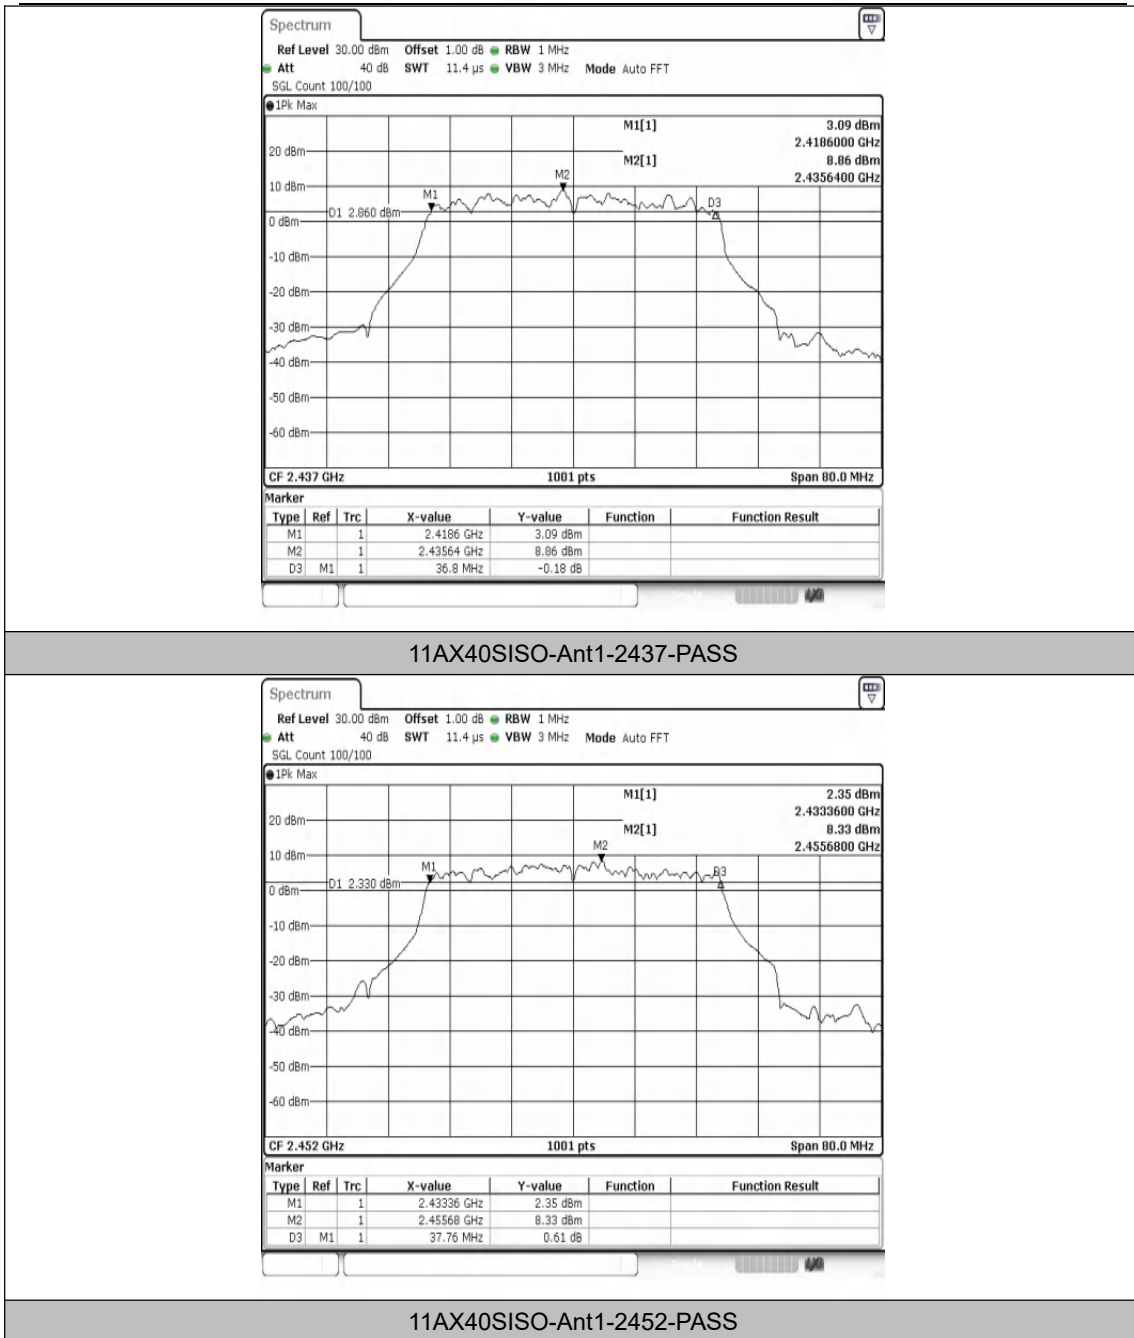



Appendix B: 99% Occupied Bandwidth


Test Result

Test Mode	Antenna	Channel Frequency[MHz]	OCB [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11B	Ant1	2412	14.865	2404.6474	2419.5125	---	---
11B	Ant1	2437	14.865	2429.6474	2444.5125	---	---
11B	Ant1	2462	14.865	2454.6474	2469.5125	---	---
11G	Ant1	2412	17.742	2403.1688	2420.9111	---	---
11G	Ant1	2437	18.062	2427.2897	2445.3516	---	---
11G	Ant1	2462	17.662	2452.7692	2470.4316	---	---
11N20SISO	Ant1	2412	18.462	2402.6893	2421.1508	---	---
11N20SISO	Ant1	2437	18.022	2428.0490	2446.0709	---	---
11N20SISO	Ant1	2462	18.541	2452.8891	2471.4306	---	---
11N40SISO	Ant1	2422	36.364	2403.8581	2440.2218	---	---
11N40SISO	Ant1	2437	36.683	2418.4585	2455.1419	---	---
11N40SISO	Ant1	2452	36.763	2433.6983	2470.4615	---	---
11AX20SISO	Ant1	2412	19.301	2402.1698	2421.4705	---	---
11AX20SISO	Ant1	2437	19.061	2427.4895	2446.5504	---	---
11AX20SISO	Ant1	2462	19.221	2452.3696	2471.5904	---	---
11AX40SISO	Ant1	2422	38.122	2402.7393	2440.8611	---	---
11AX40SISO	Ant1	2437	37.642	2418.0589	2455.7013	---	---
11AX40SISO	Ant1	2452	38.042	2432.8192	2470.8611	---	---

Test Graphs

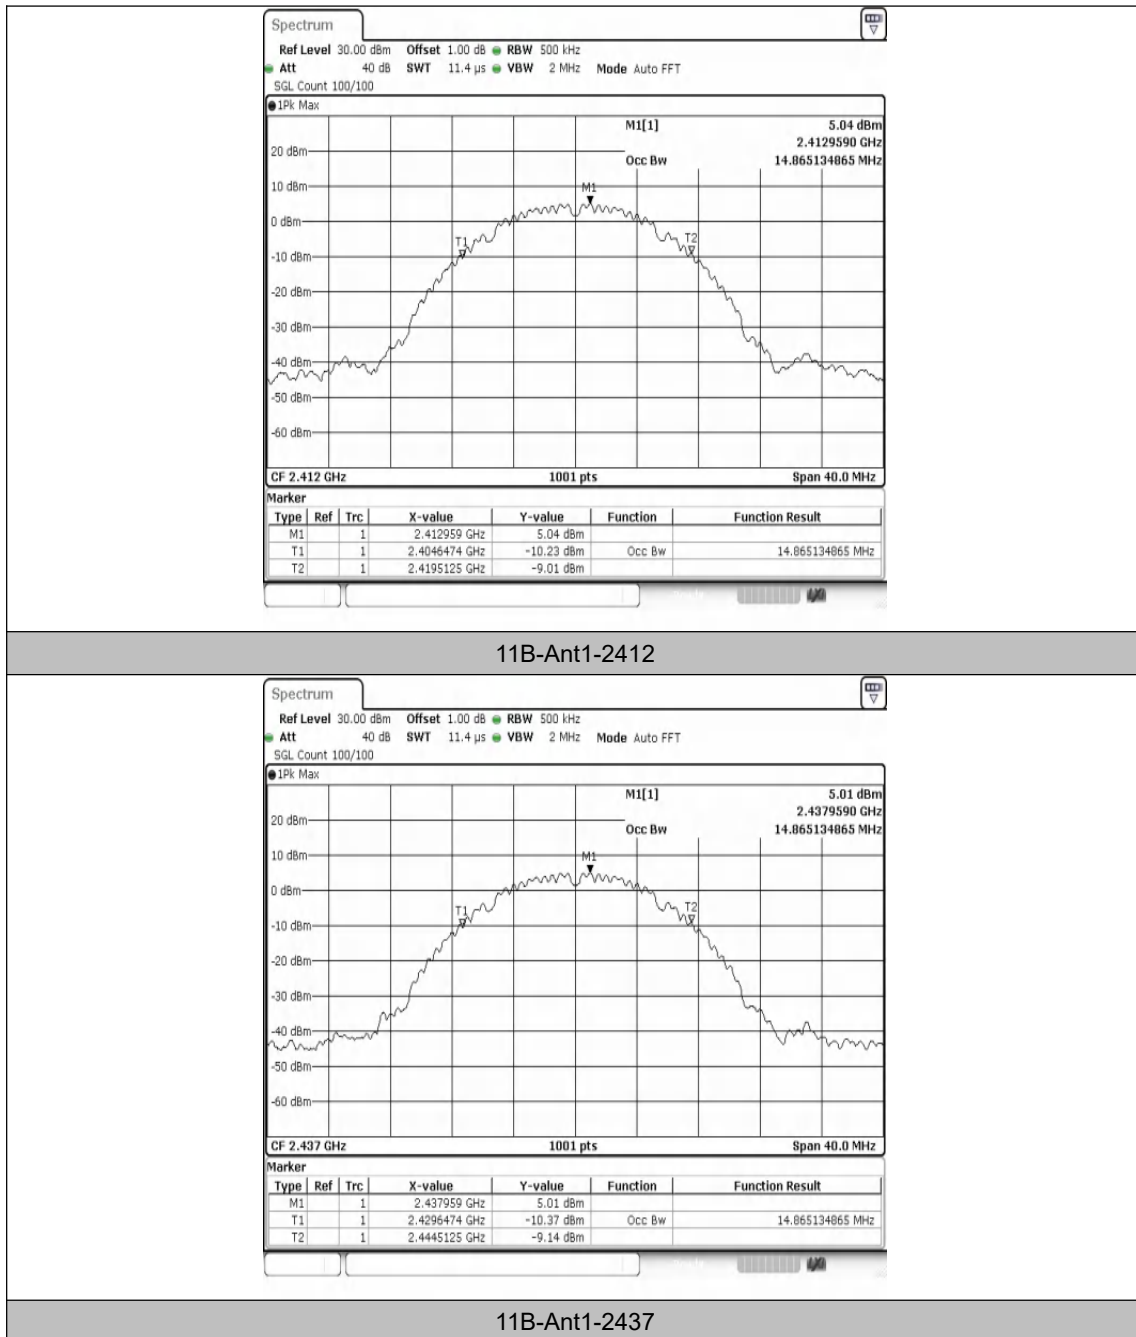

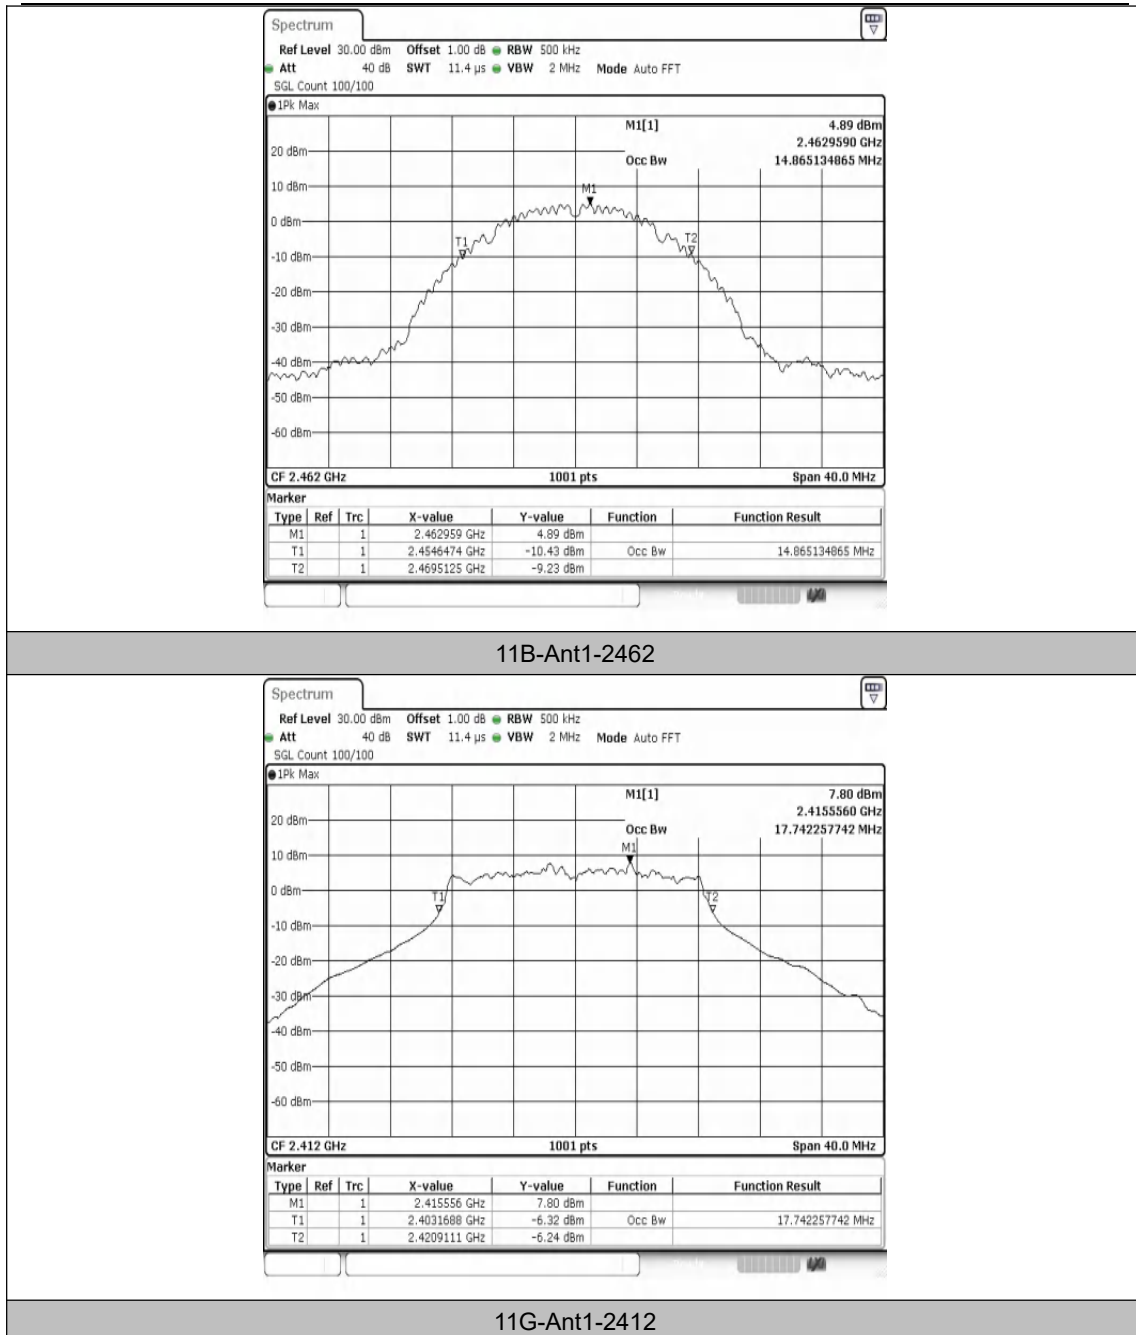


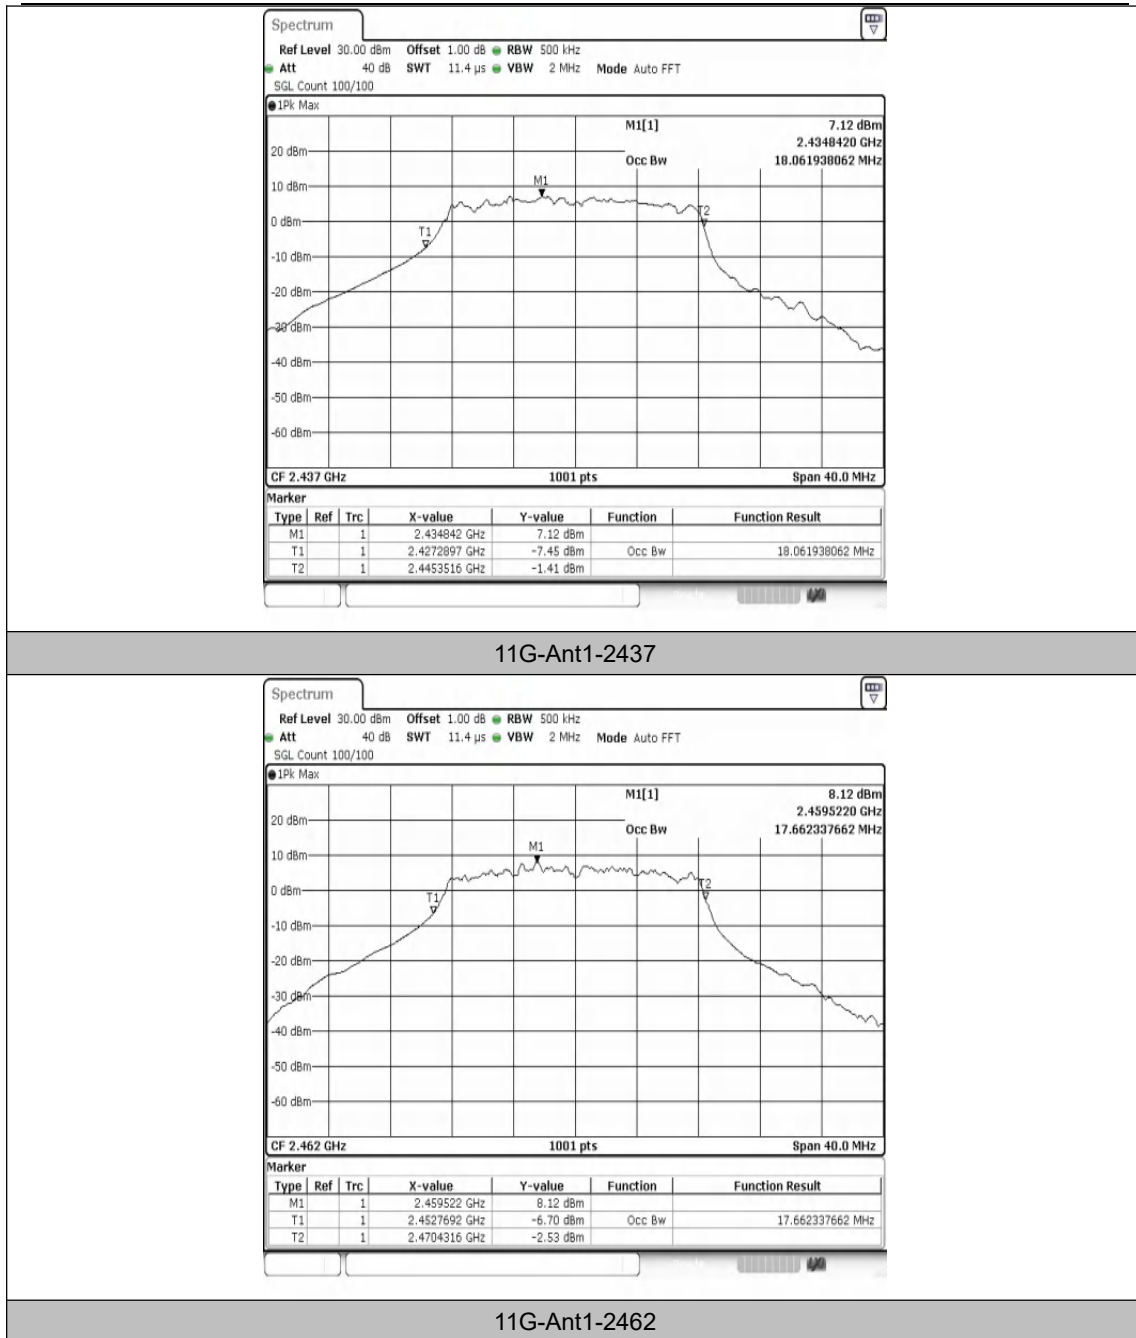



Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

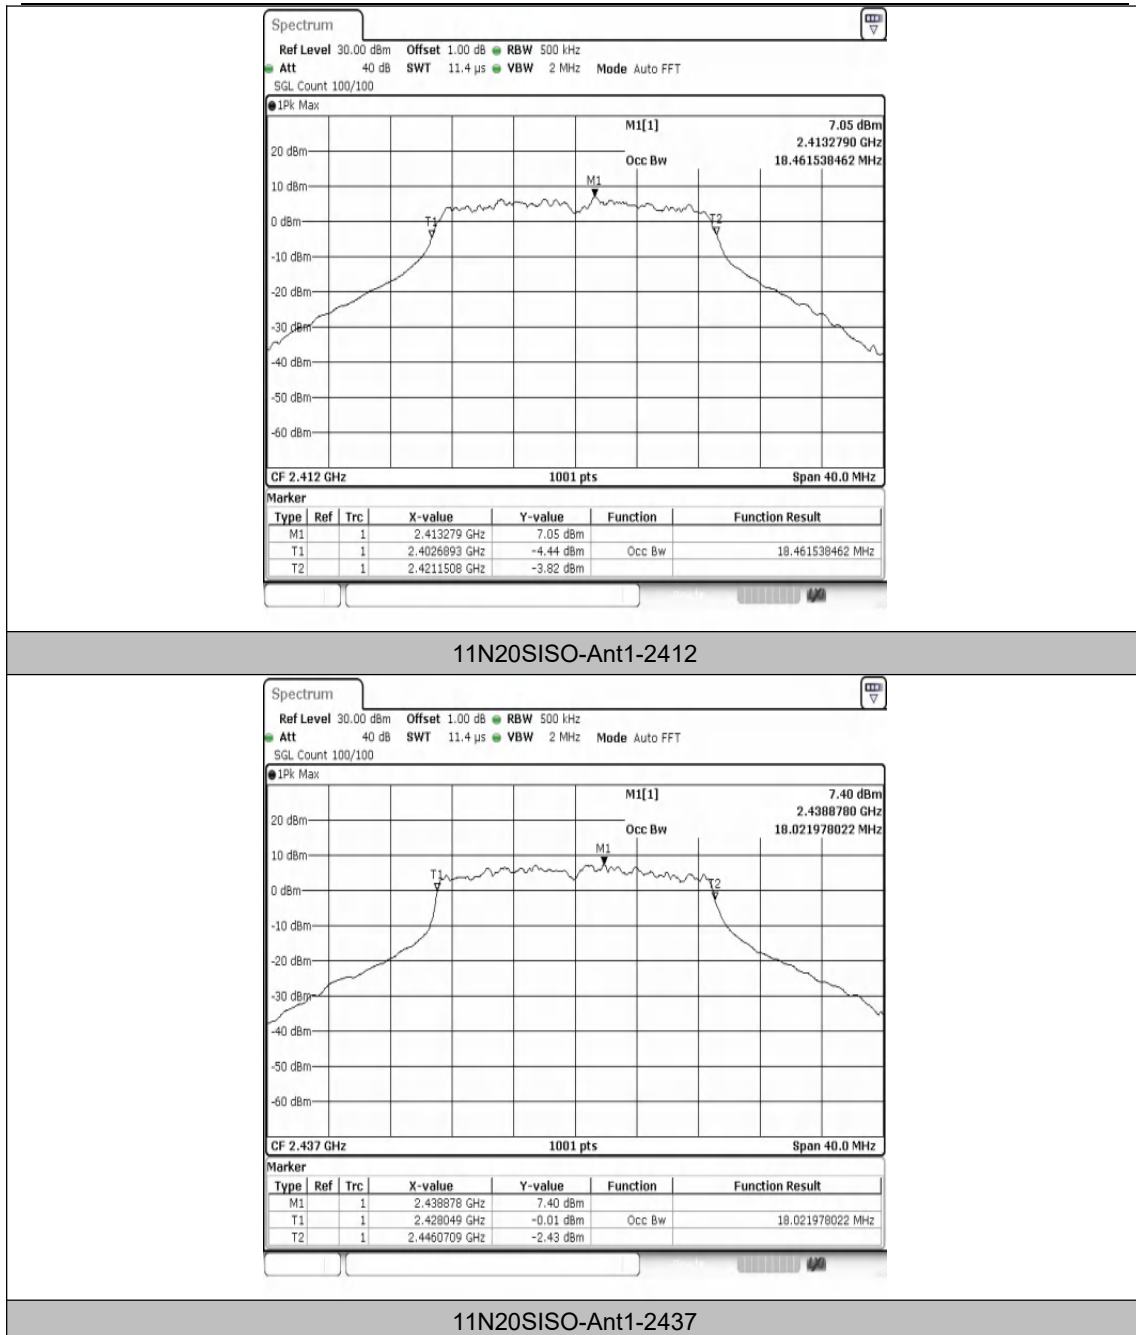


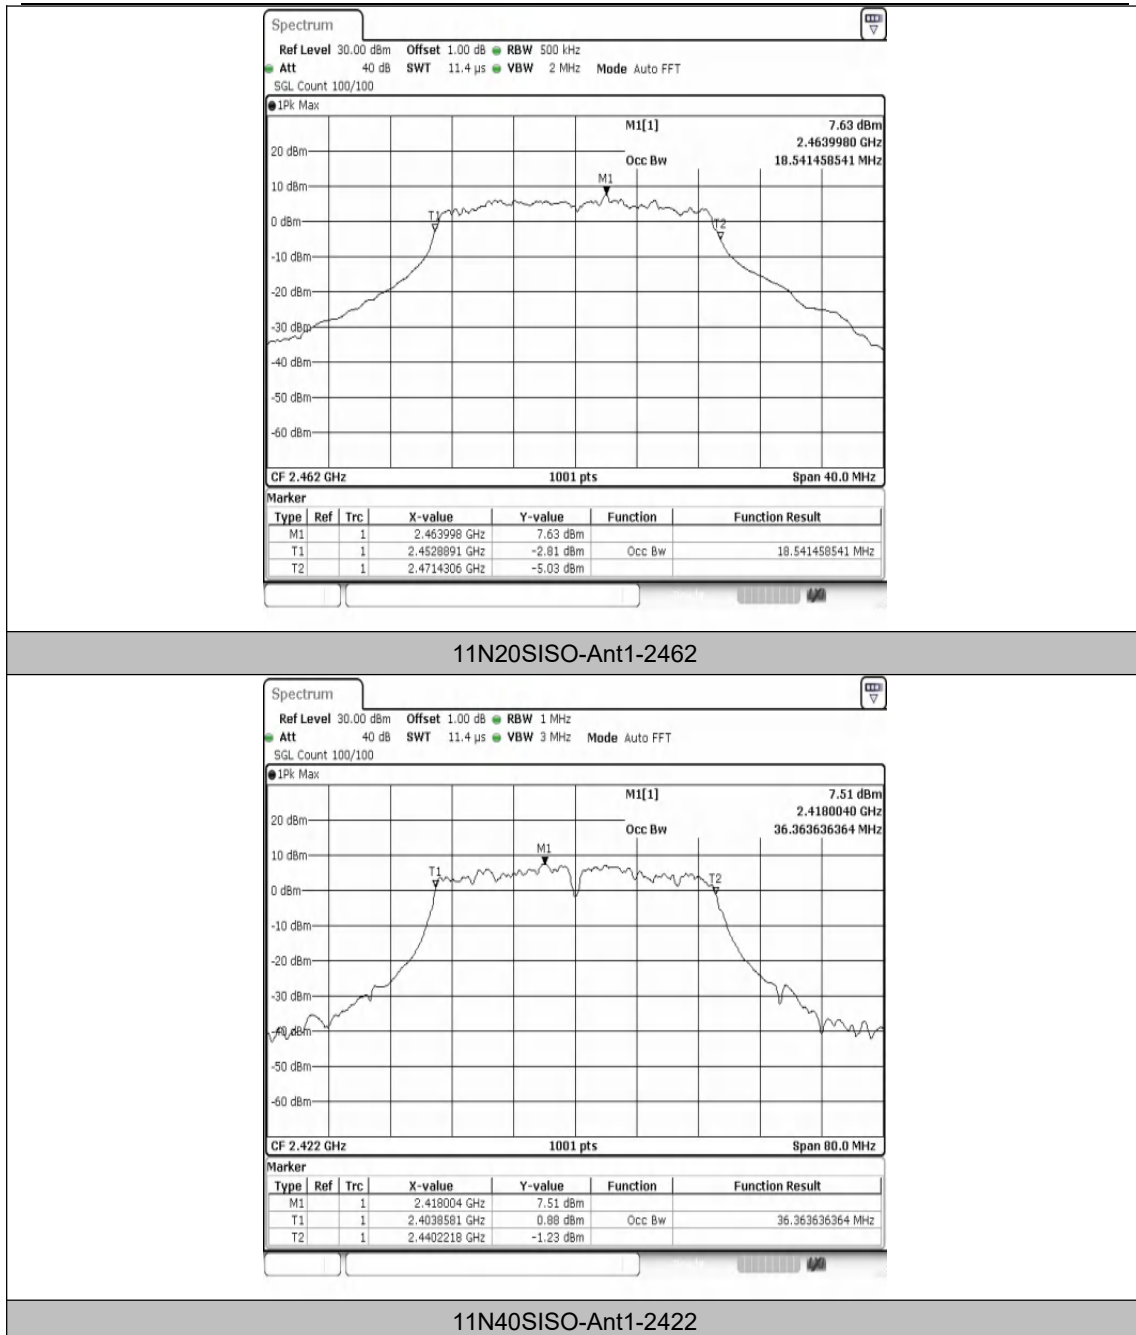

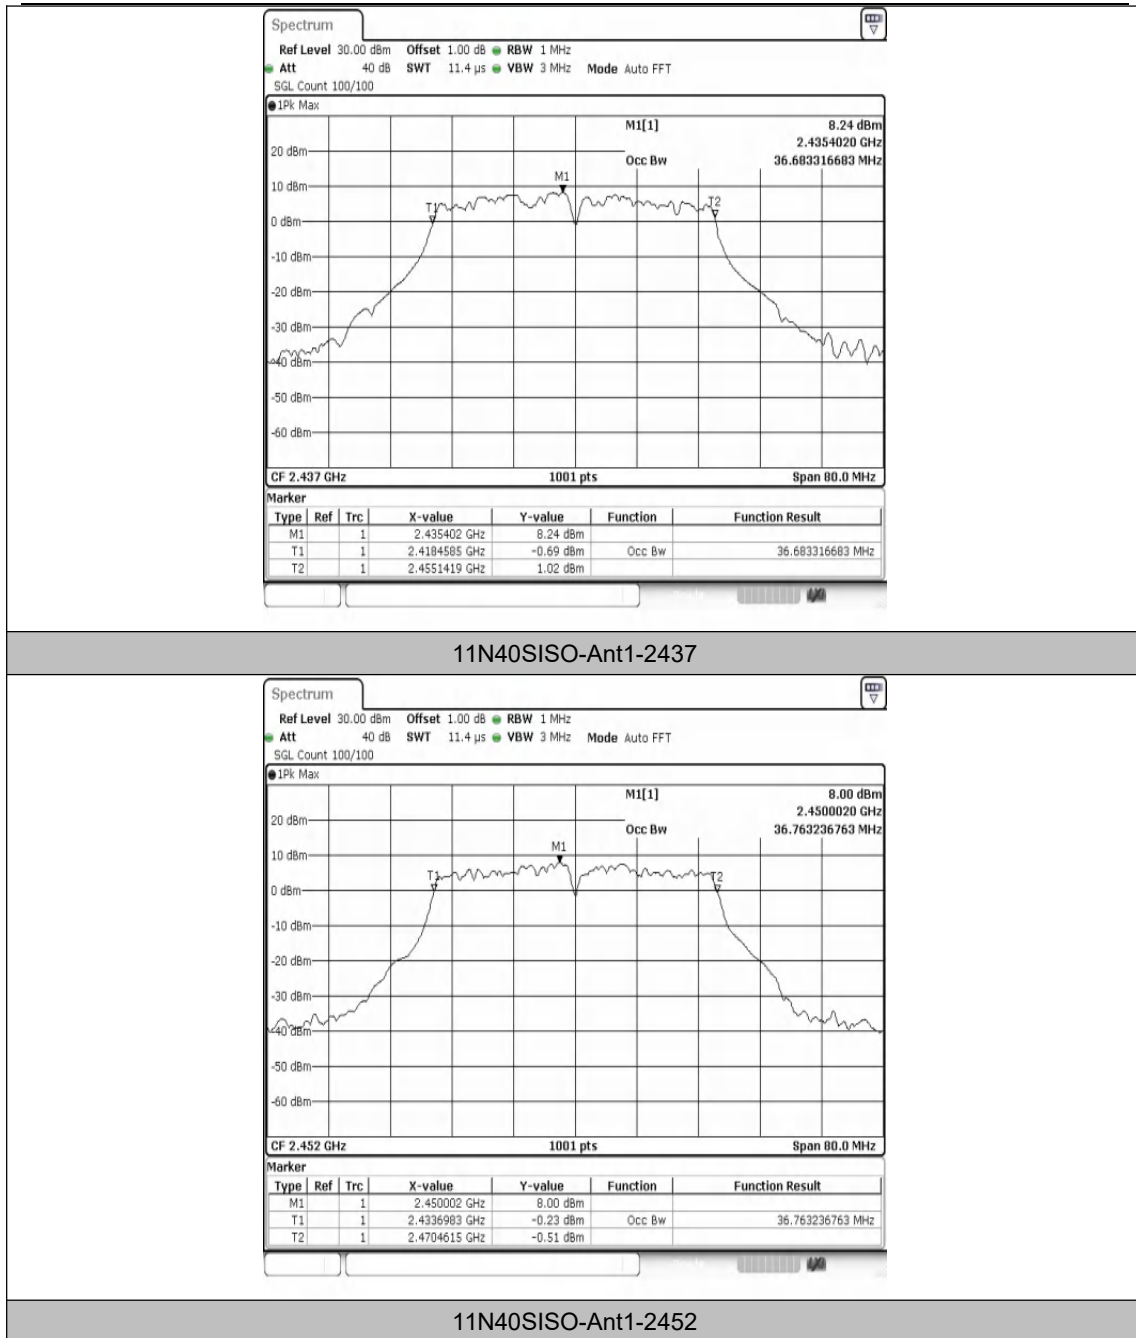


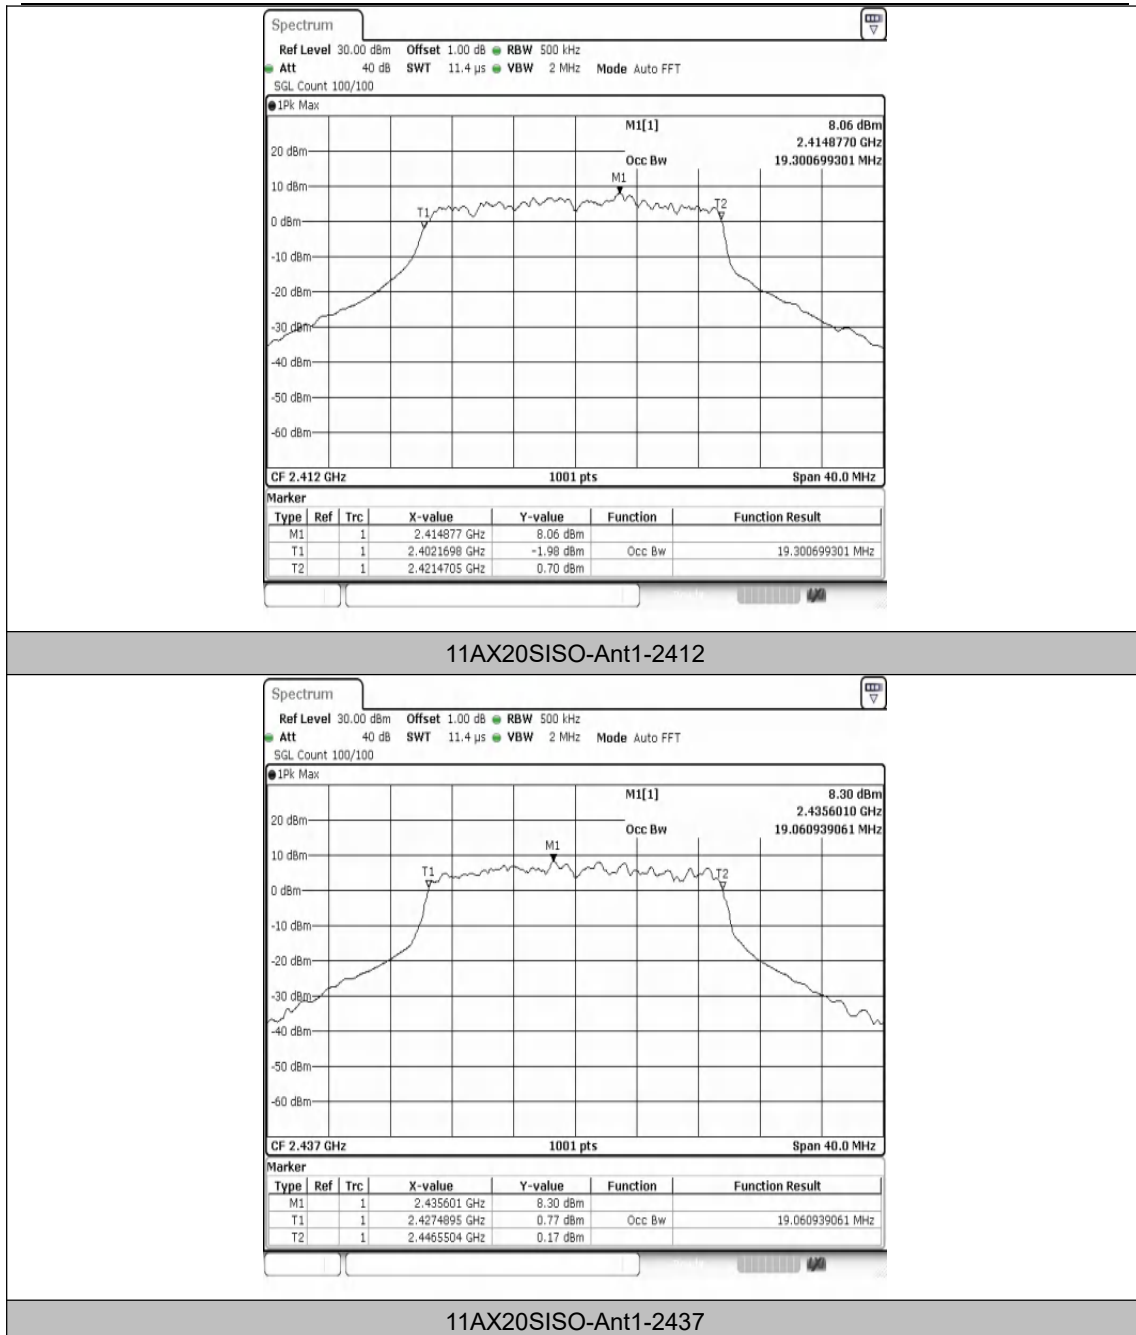

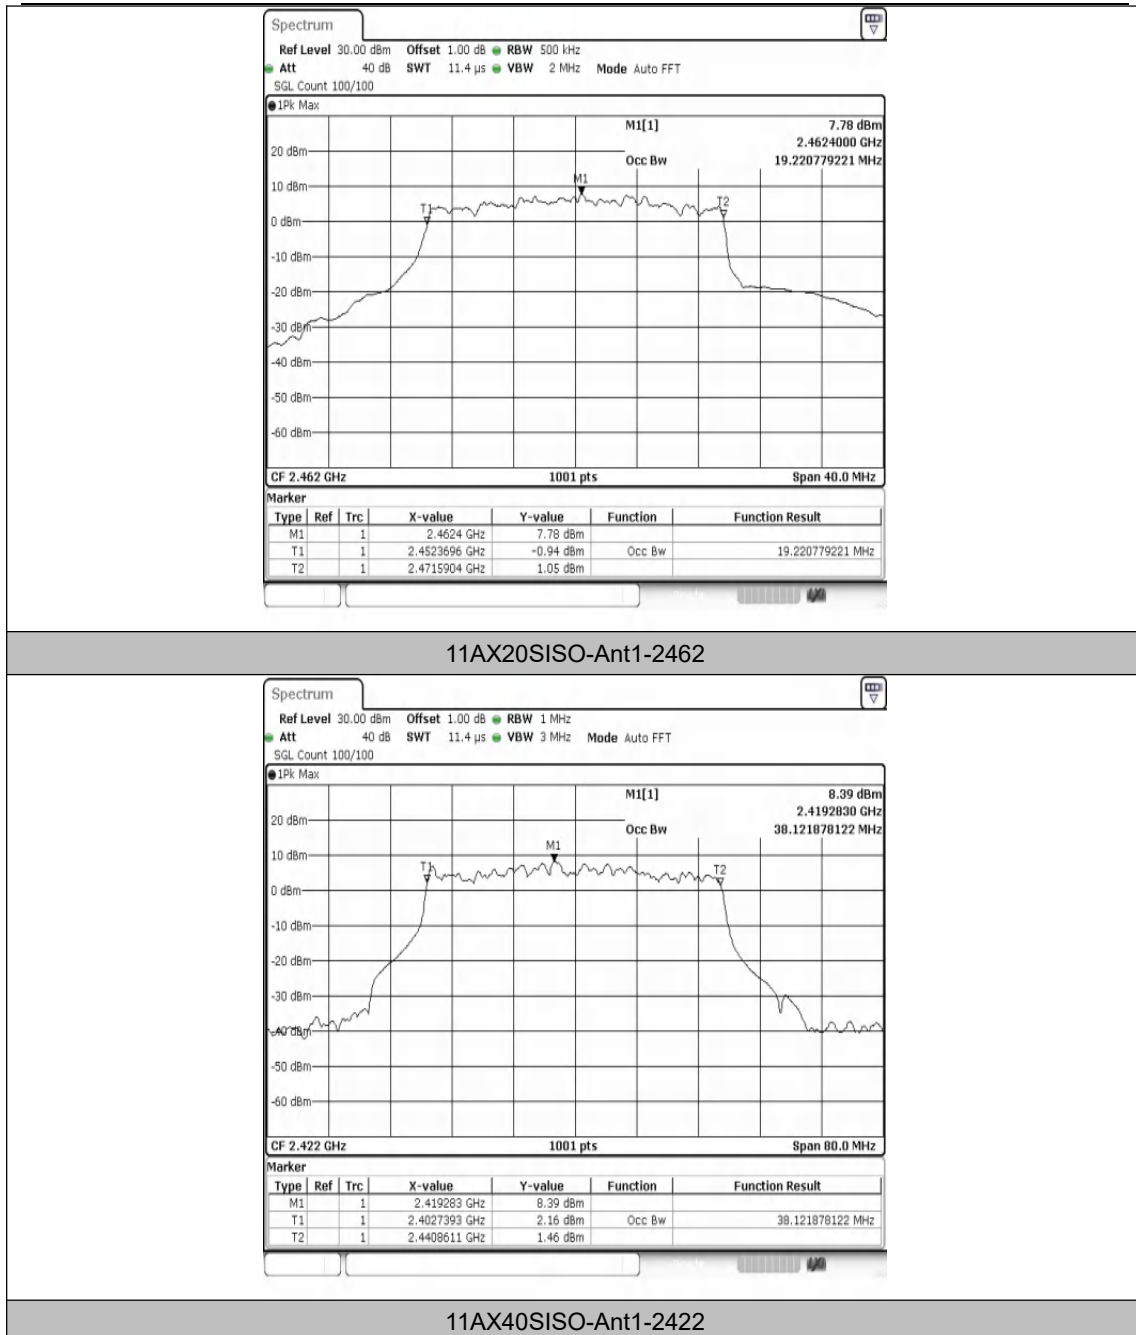

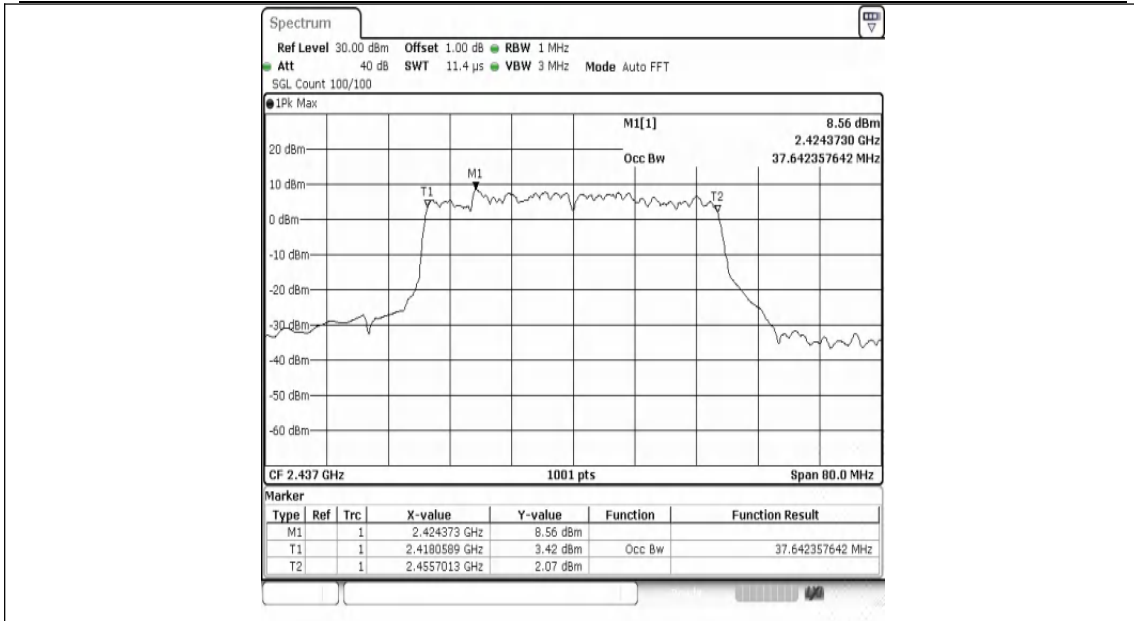

11AX40SISO-Ant1-2437

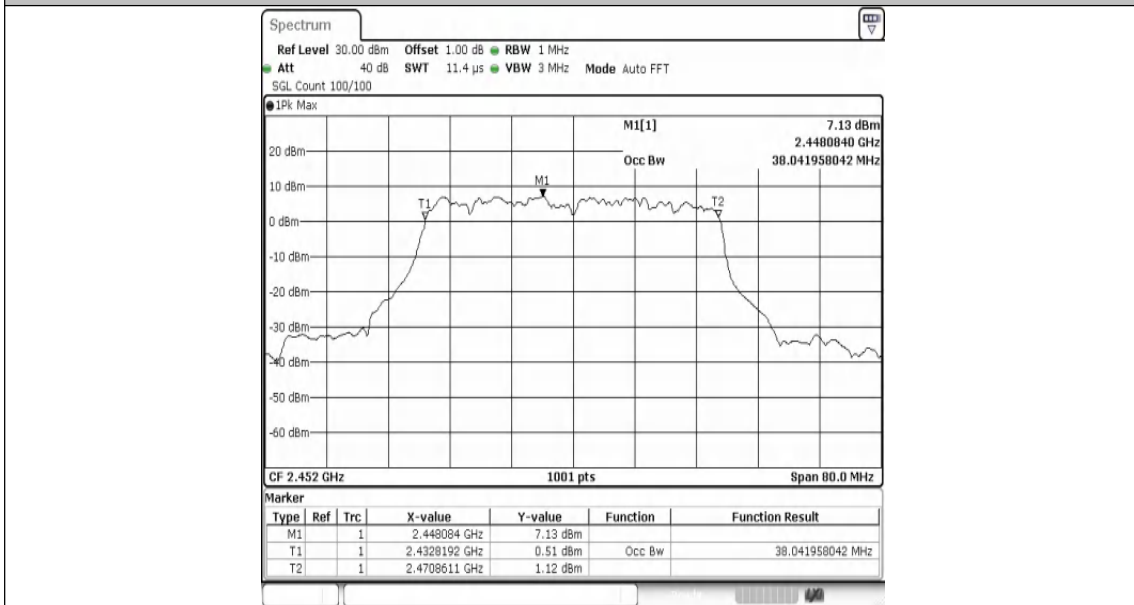

11AX40SISO-Ant1-2452

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Appendix C: Maximum conducted output power

Test Result Average

Test Mode	Antenna	Frequency[MHz]	Result[dBm]	Limit[dBm]	Verdict
11B	Ant1	2412	13.56	≤30.00	PASS
11B	Ant1	2437	13.50	≤30.00	PASS
11B	Ant1	2462	13.36	≤30.00	PASS
11G	Ant1	2412	14.05	≤30.00	PASS
11G	Ant1	2437	14.63	≤30.00	PASS
11G	Ant1	2462	14.24	≤30.00	PASS
11N20SISO	Ant1	2412	13.76	≤30.00	PASS
11N20SISO	Ant1	2437	14.38	≤30.00	PASS
11N20SISO	Ant1	2462	14.08	≤30.00	PASS
11N40SISO	Ant1	2422	12.92	≤30.00	PASS
11N40SISO	Ant1	2437	13.86	≤30.00	PASS
11N40SISO	Ant1	2452	13.82	≤30.00	PASS
11AX20SISO	Ant1	2412	13.41	≤30.00	PASS
11AX20SISO	Ant1	2437	14.18	≤30.00	PASS
11AX20SISO	Ant1	2462	13.81	≤30.00	PASS
11AX40SISO	Ant1	2422	12.99	≤30.00	PASS
11AX40SISO	Ant1	2437	13.74	≤30.00	PASS
11AX40SISO	Ant1	2452	13.48	≤30.00	PASS

Note: 1. The cable loss are compensated in the graph


Test Graphs Average

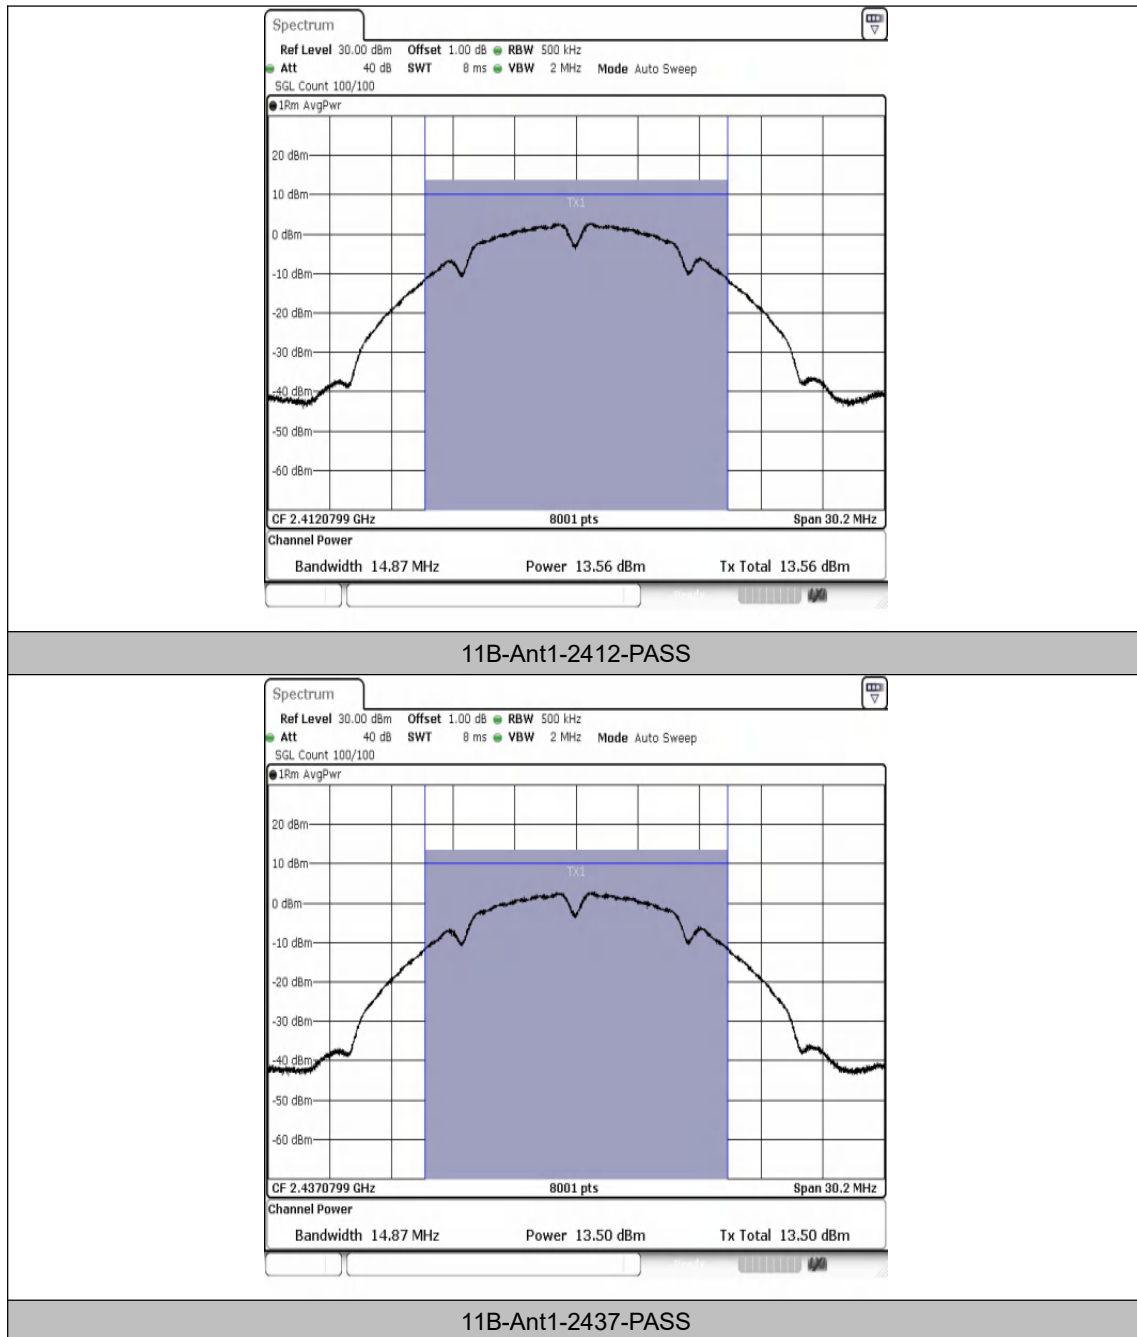

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

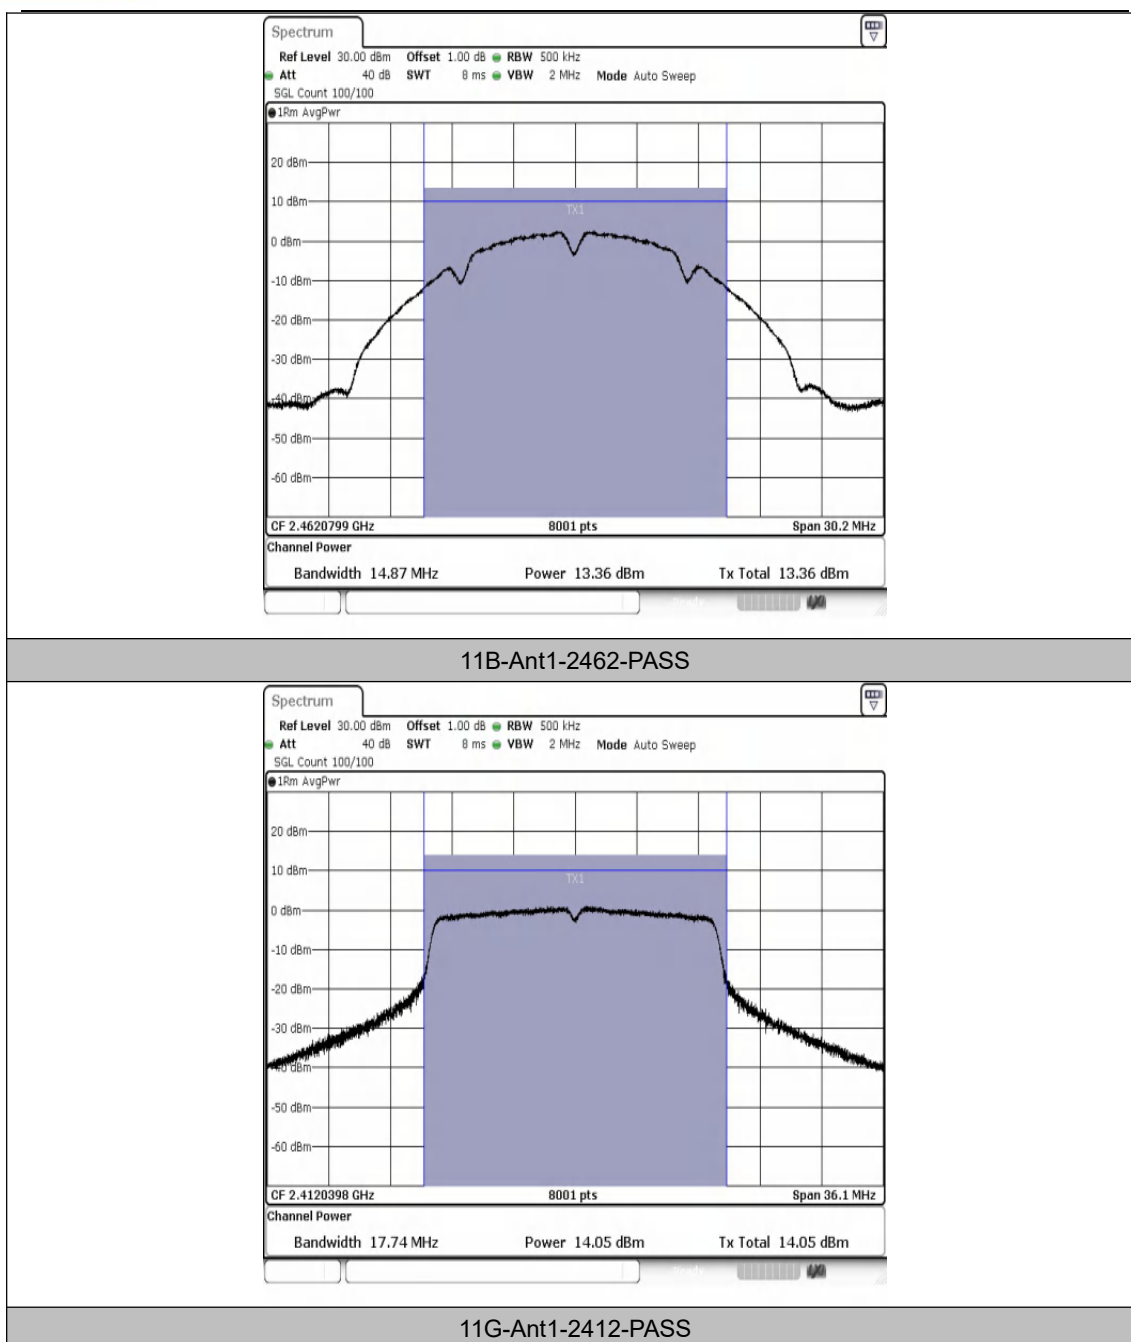

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

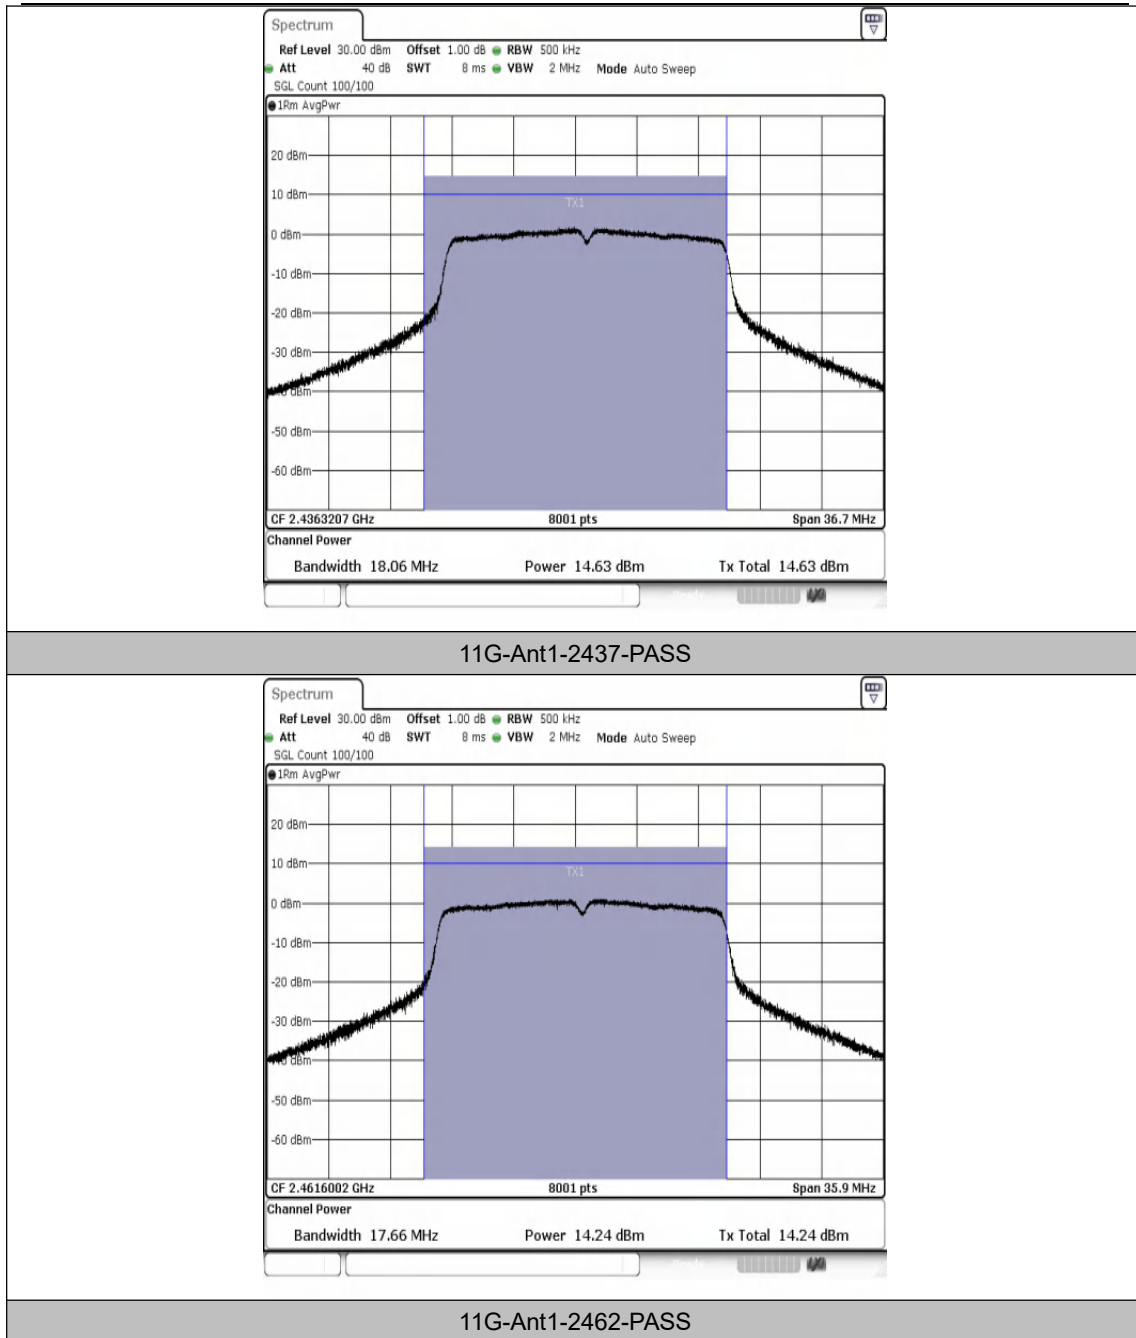


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

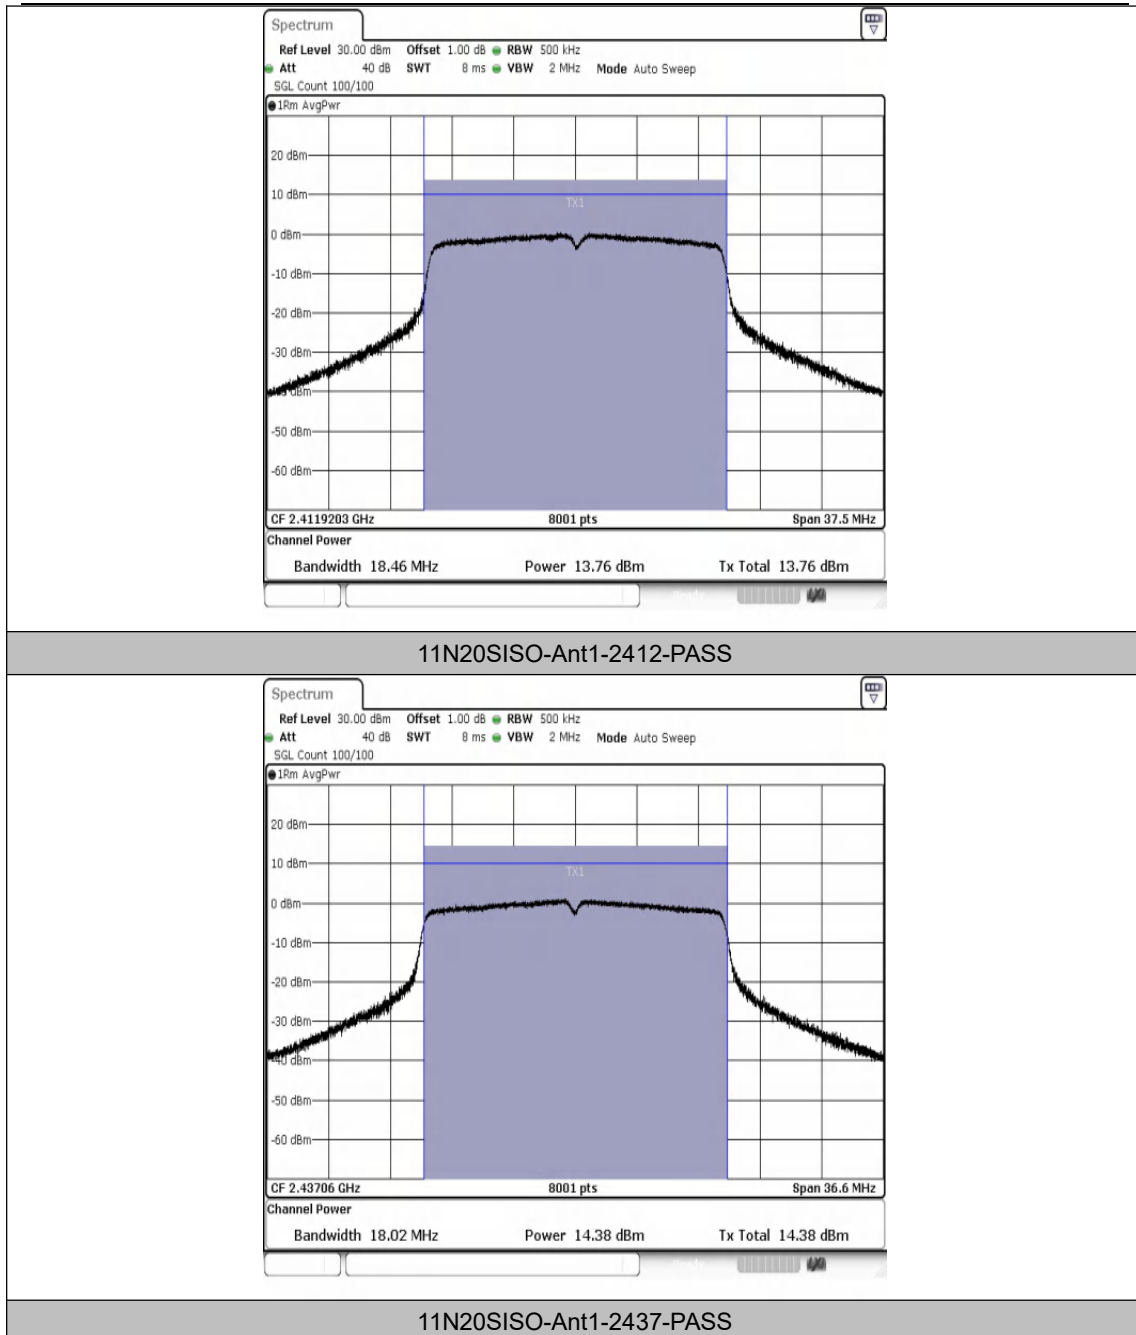


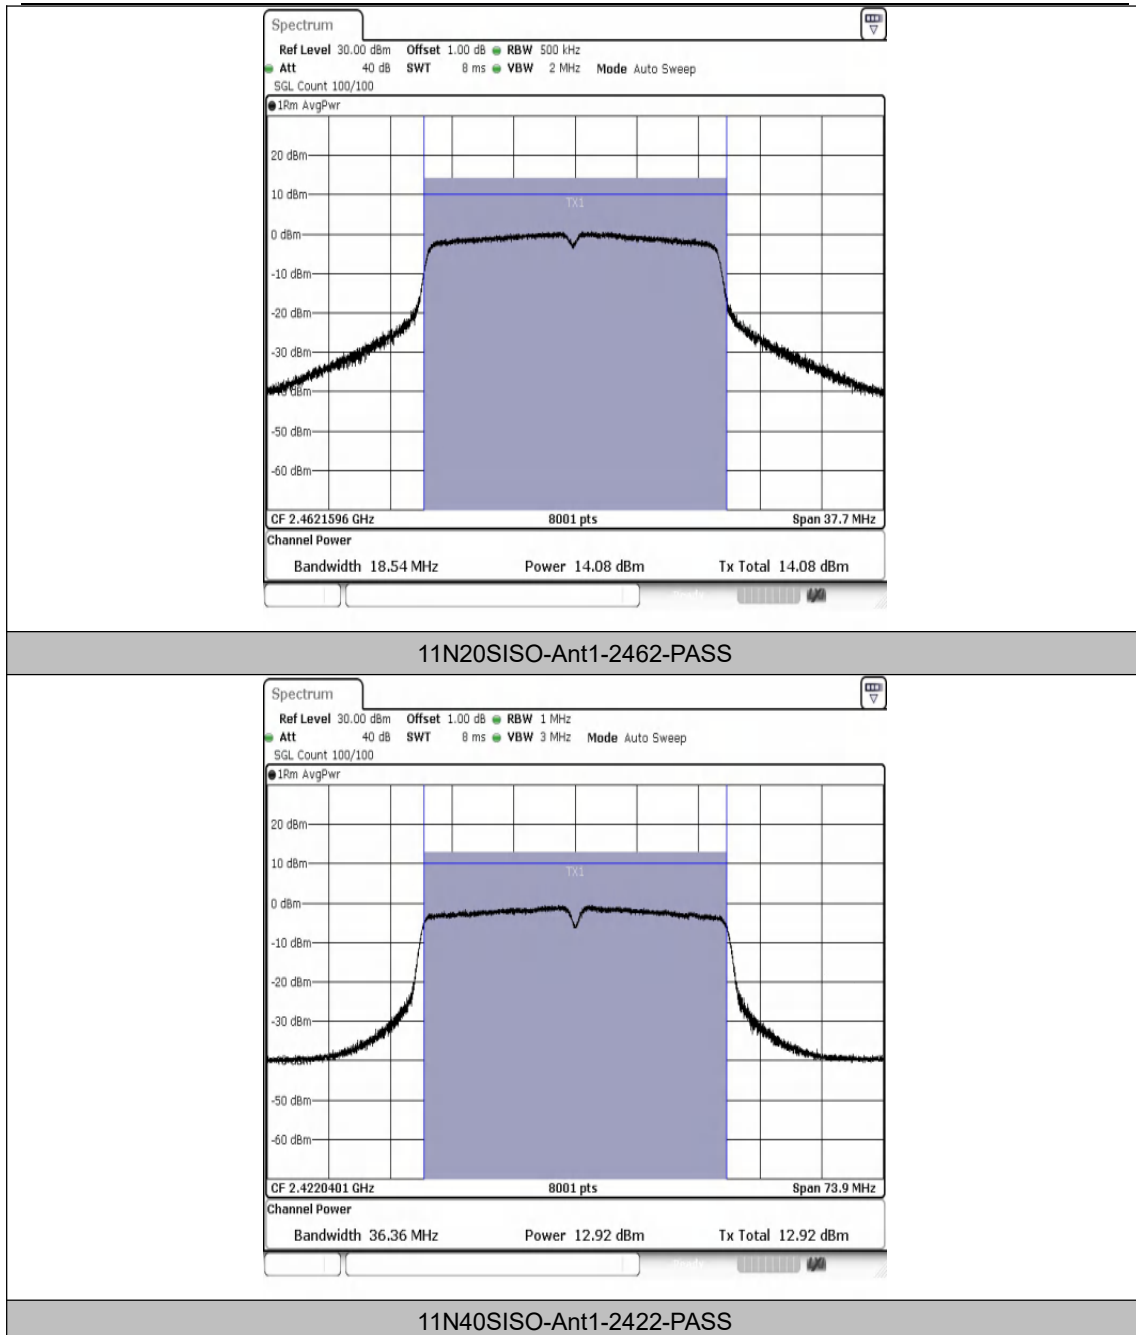

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

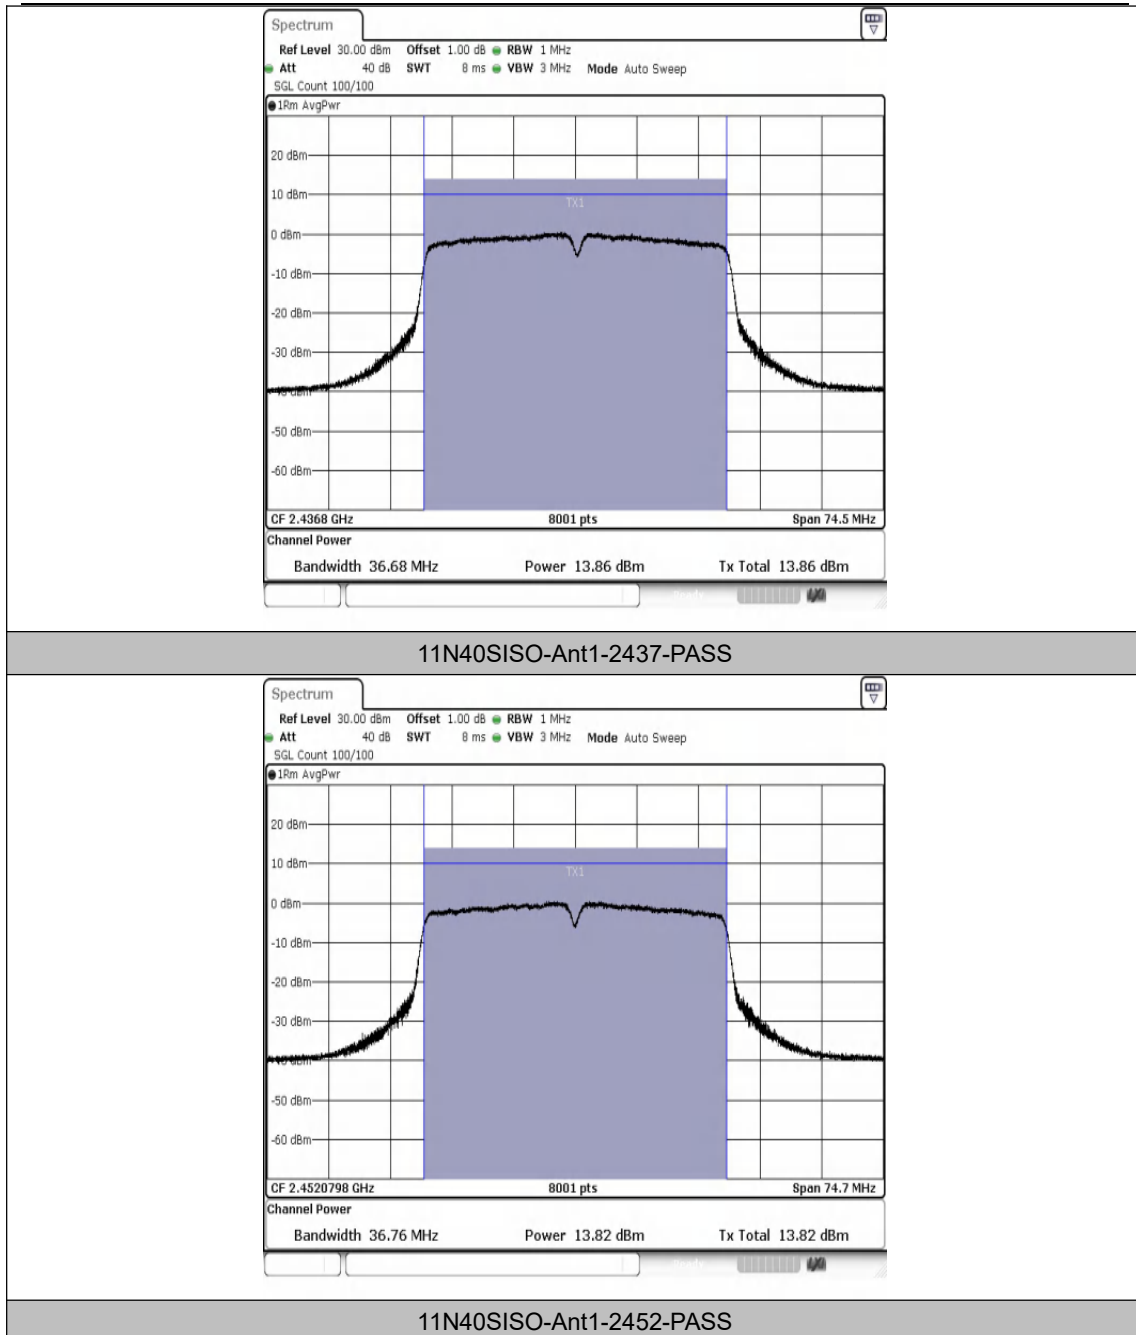

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

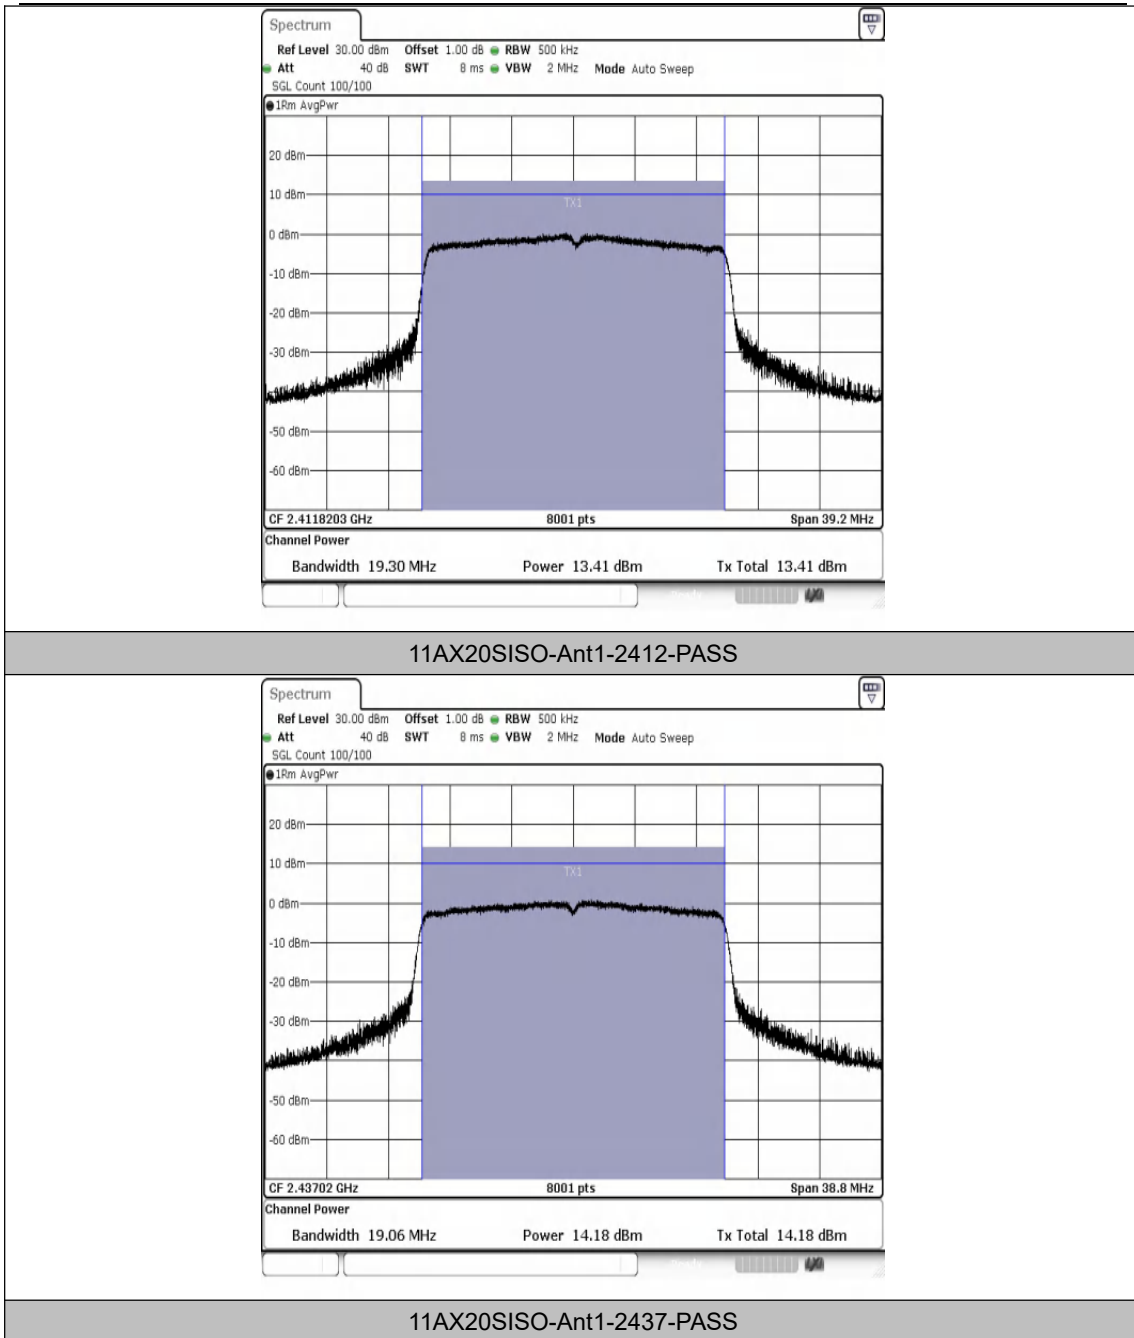

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

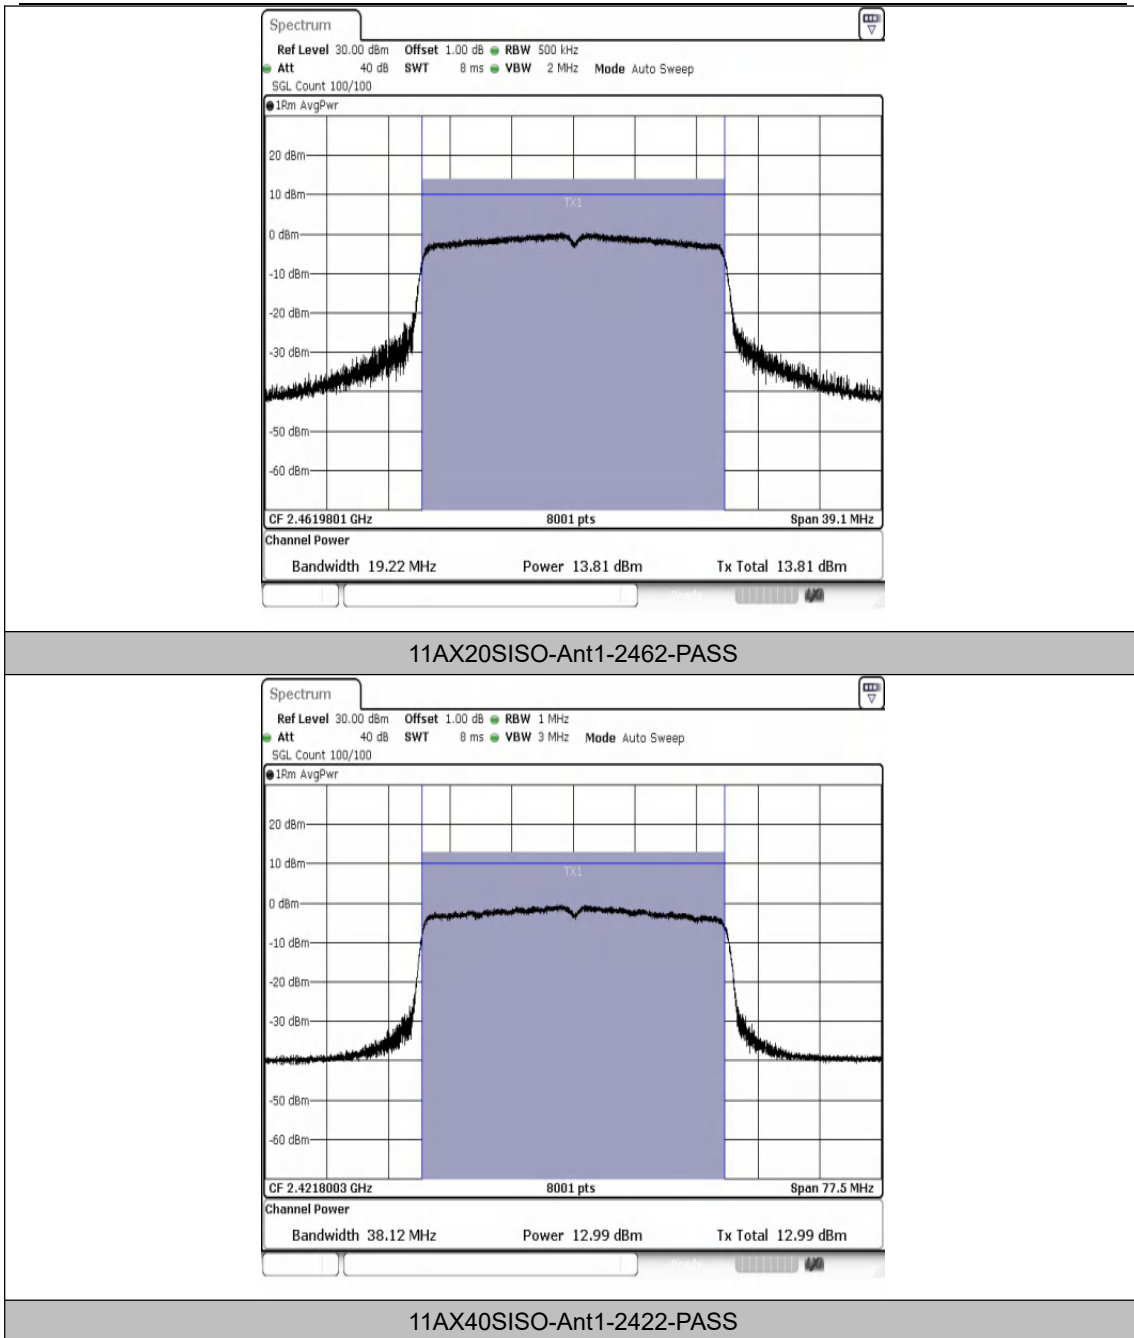

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

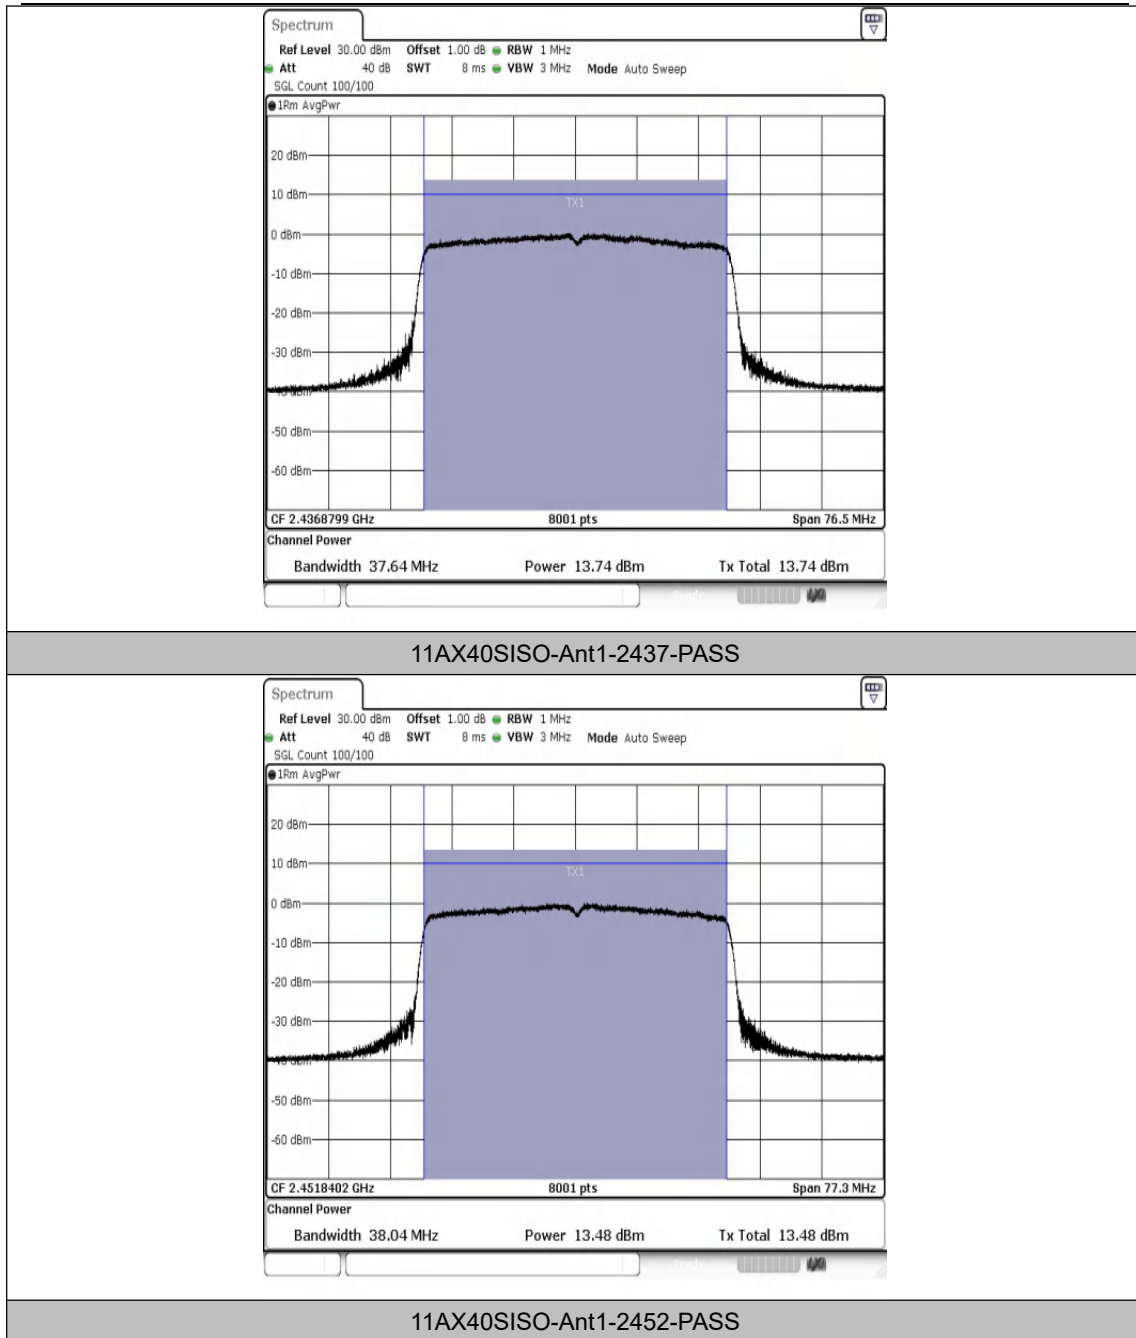

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Appendix D: Maximum power spectral density

Test Result

Test Mode	Antenna	Frequency [MHz]	Result [dBm/3kHz]	Limit [dBm/3kHz]	Verdict
11B	Ant1	2412	-18.34	≤8.00	PASS
11B	Ant1	2437	-18.27	≤8.00	PASS
11B	Ant1	2462	-18.56	≤8.00	PASS
11G	Ant1	2412	-19.74	≤8.00	PASS
11G	Ant1	2437	-18.98	≤8.00	PASS
11G	Ant1	2462	-19.33	≤8.00	PASS
11N20SISO	Ant1	2412	-19.61	≤8.00	PASS
11N20SISO	Ant1	2437	-19.36	≤8.00	PASS
11N20SISO	Ant1	2462	-19.44	≤8.00	PASS
11N40SISO	Ant1	2422	-25.33	≤8.00	PASS
11N40SISO	Ant1	2437	-21.80	≤8.00	PASS
11N40SISO	Ant1	2452	-21.58	≤8.00	PASS
11AX20SISO	Ant1	2412	-19.57	≤8.00	PASS
11AX20SISO	Ant1	2437	-17.96	≤8.00	PASS
11AX20SISO	Ant1	2462	-18.64	≤8.00	PASS
11AX40SISO	Ant1	2422	-21.56	≤8.00	PASS
11AX40SISO	Ant1	2437	-21.44	≤8.00	PASS
11AX40SISO	Ant1	2452	-21.25	≤8.00	PASS

Note: 1. The cable loss are compensated in the graph.


Test Graphs

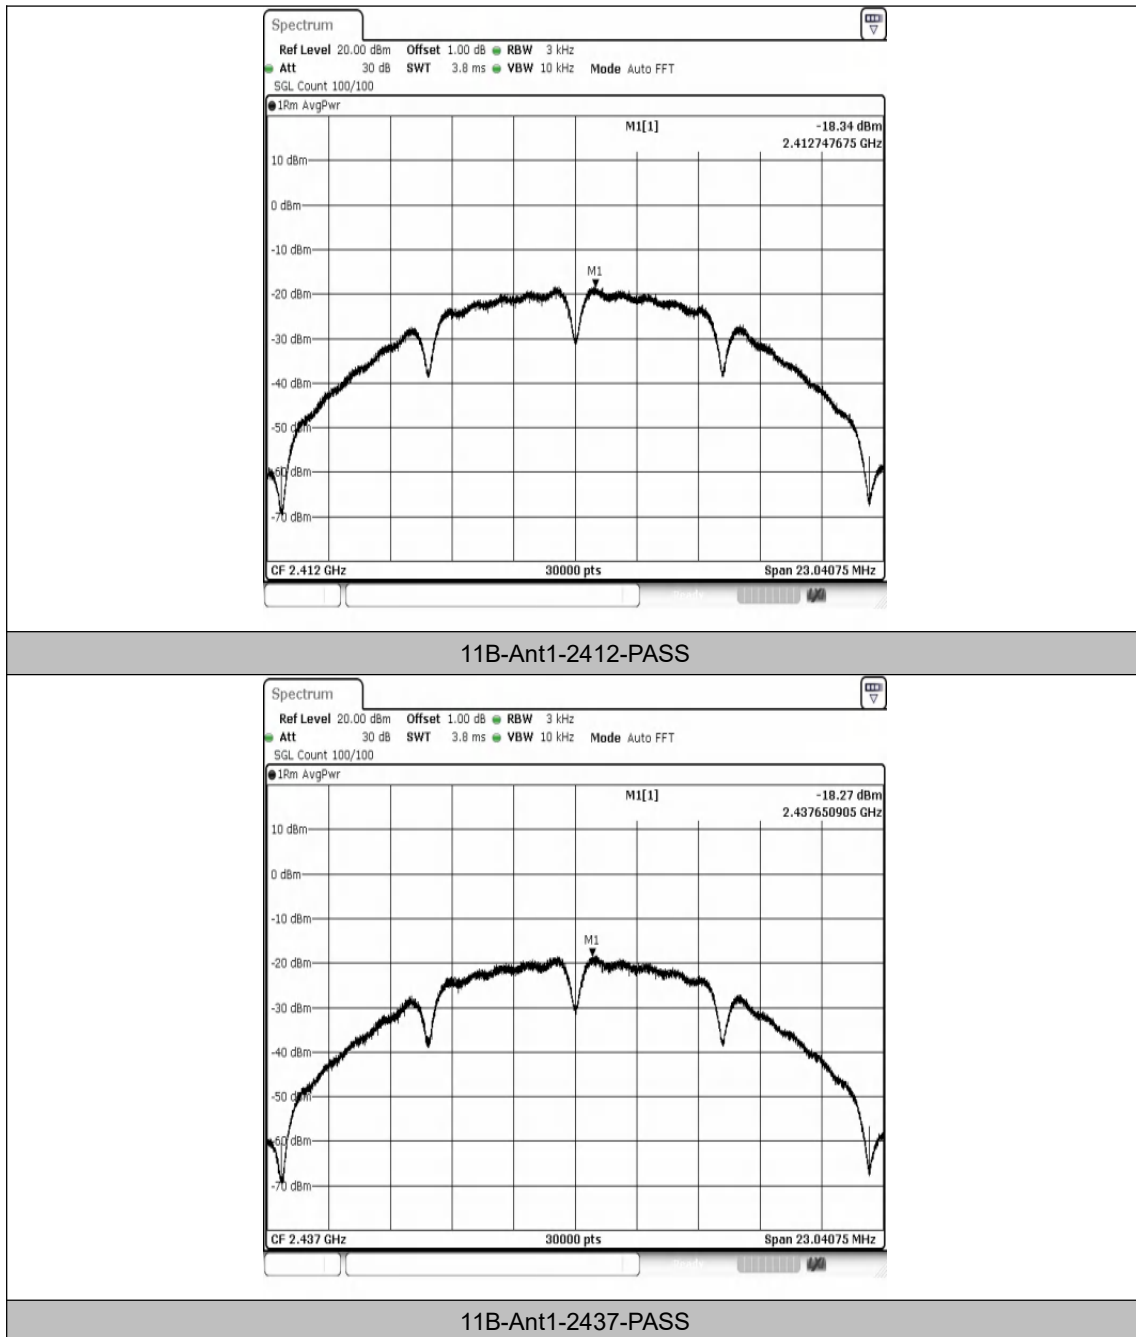

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

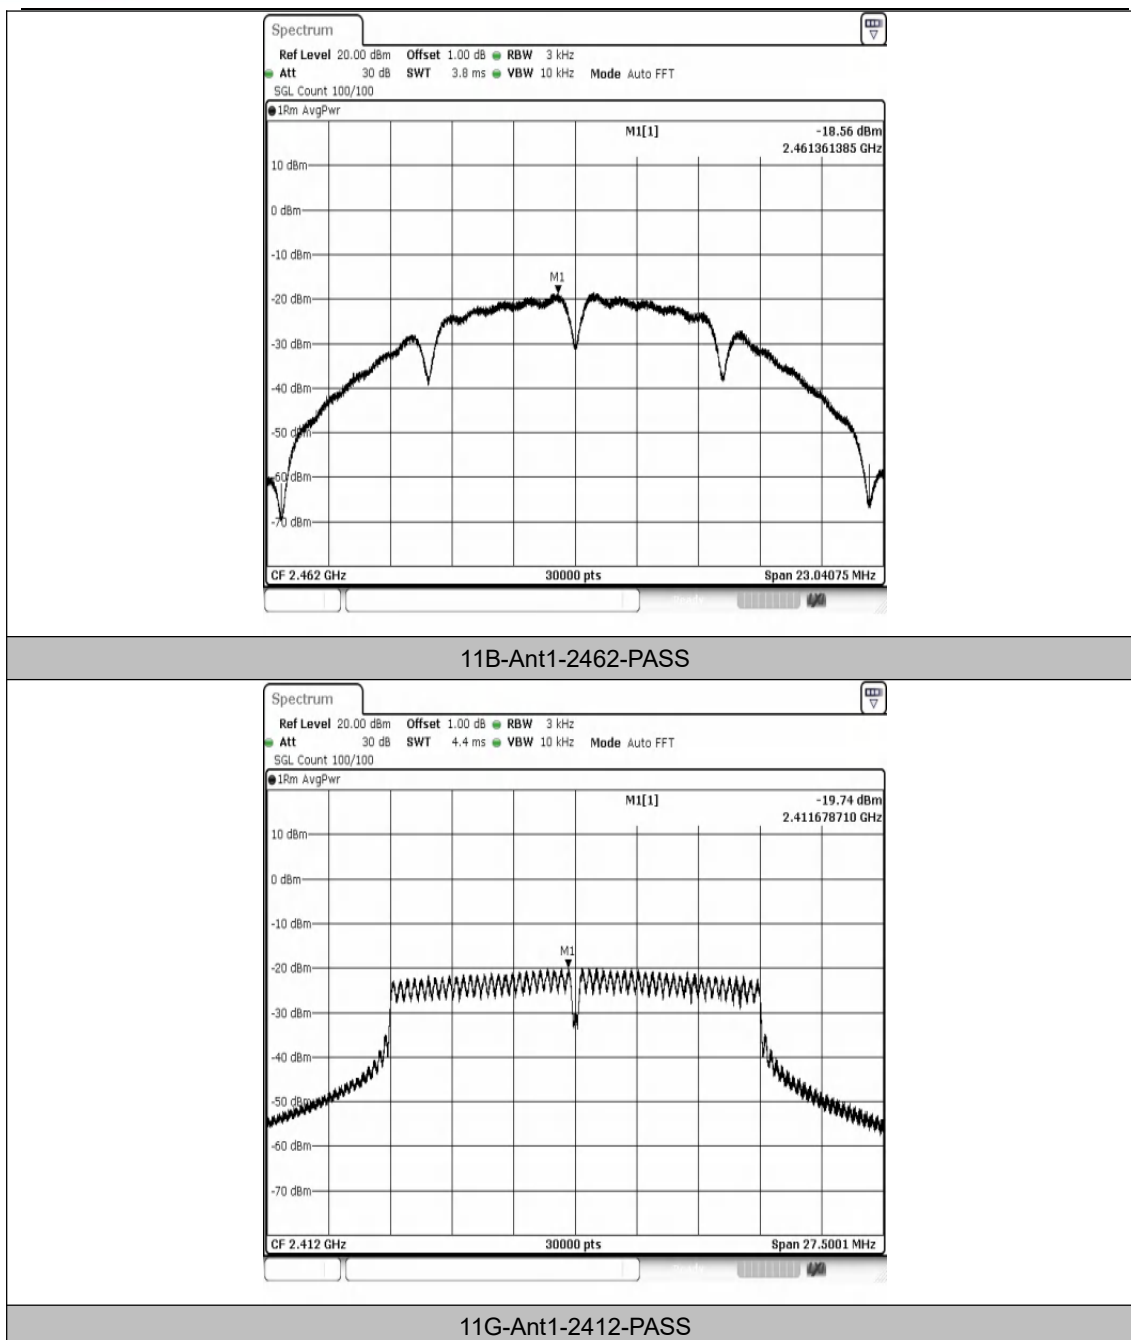

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

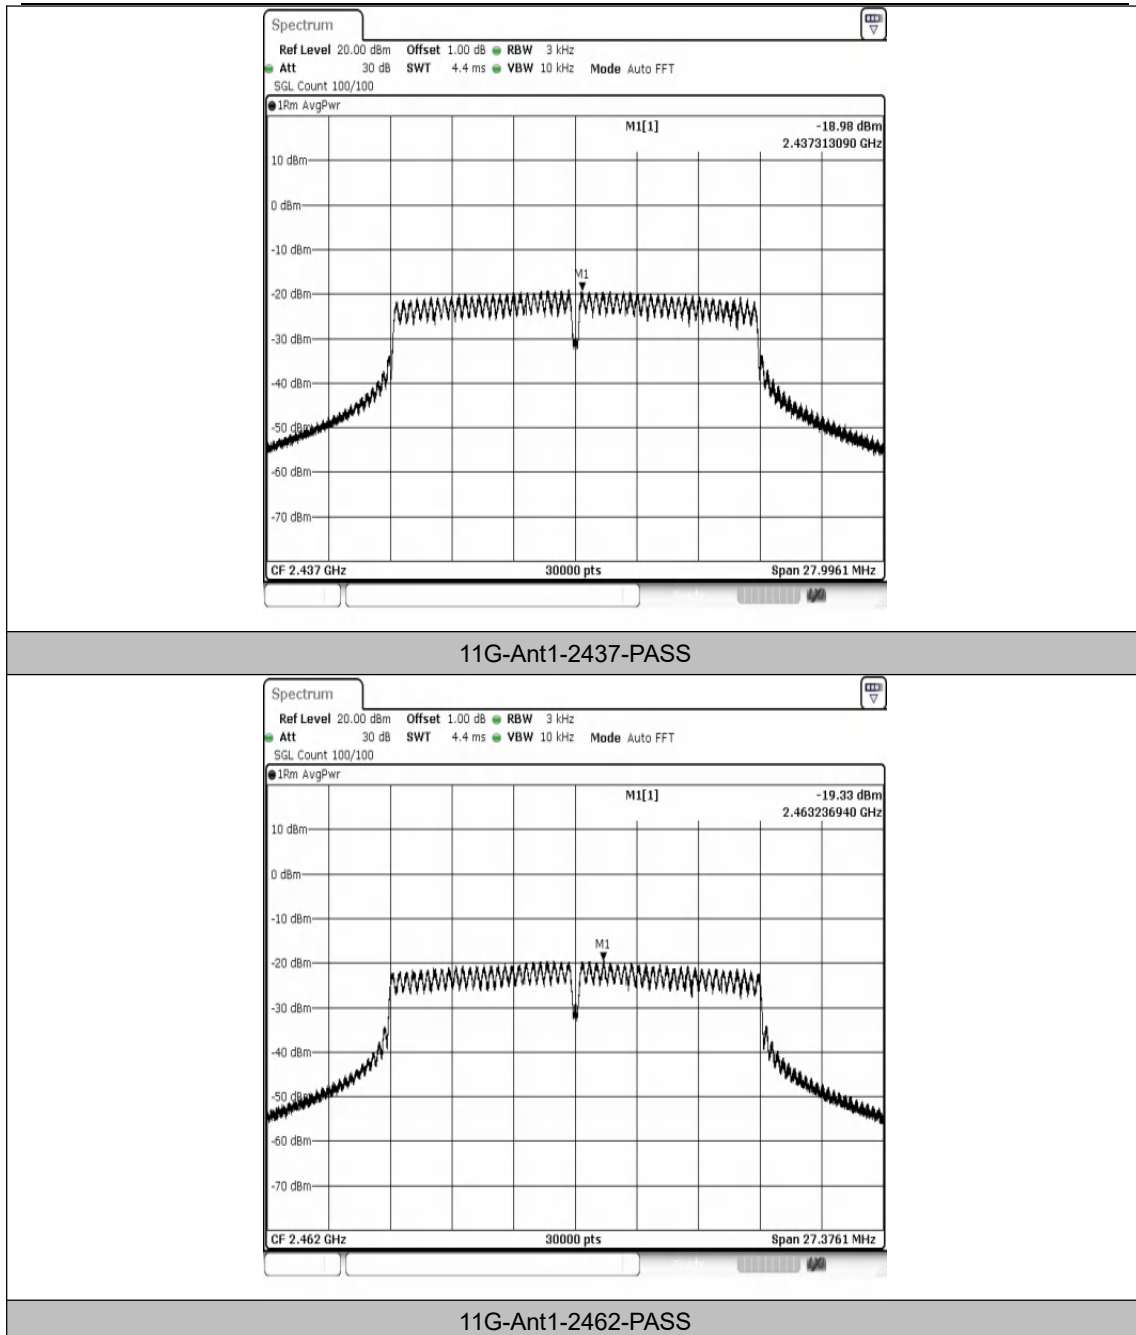



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

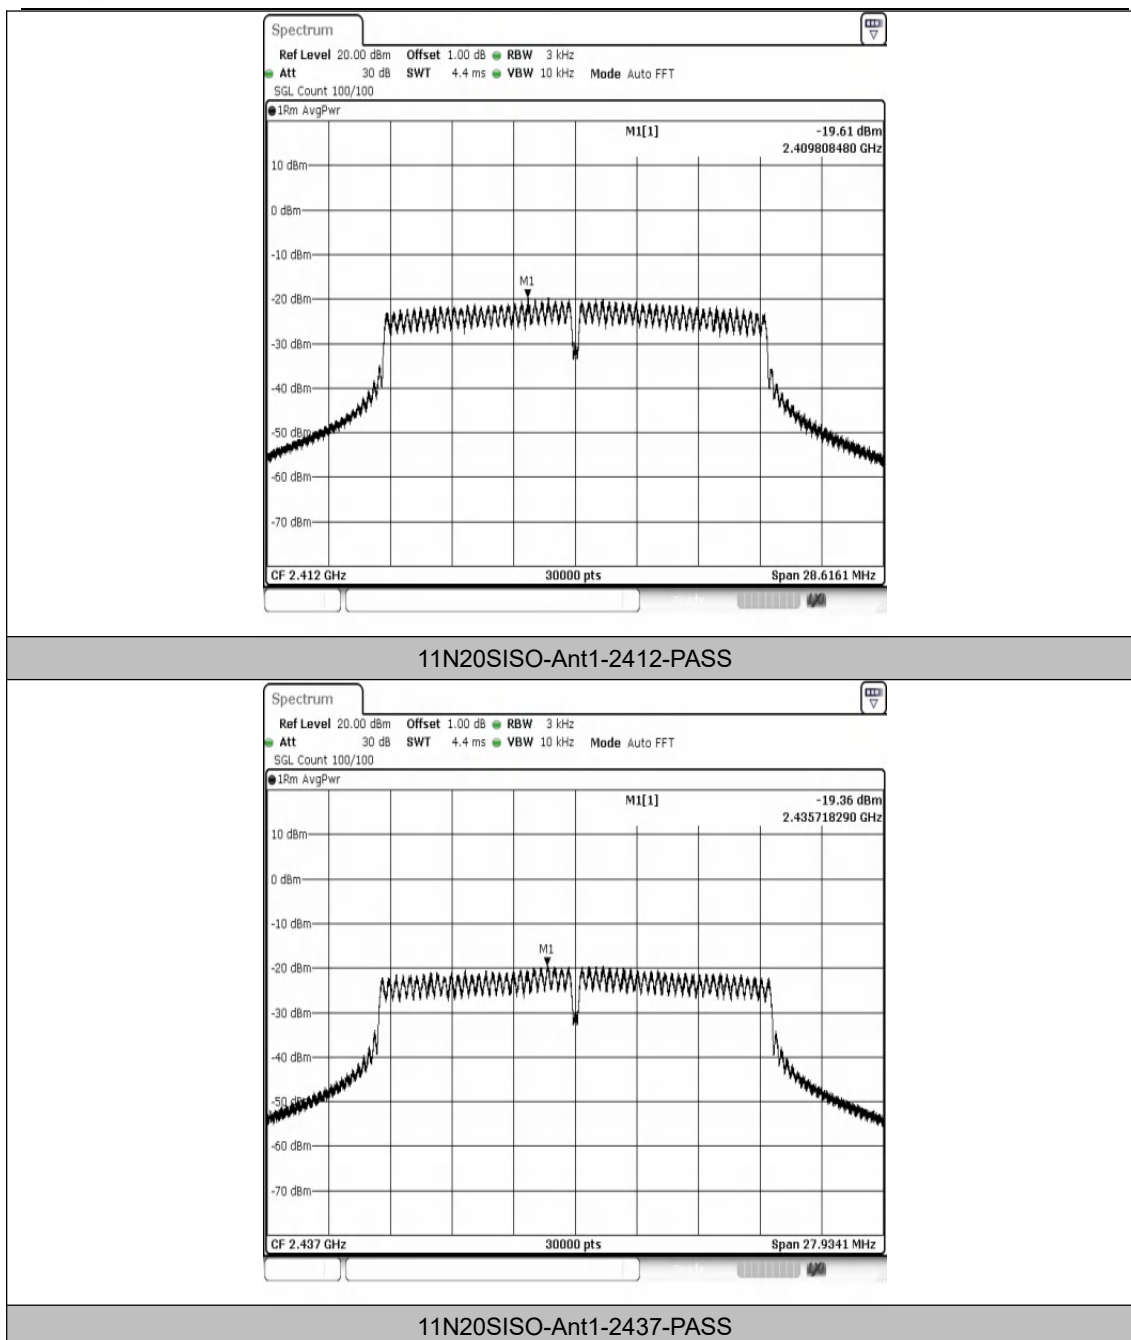

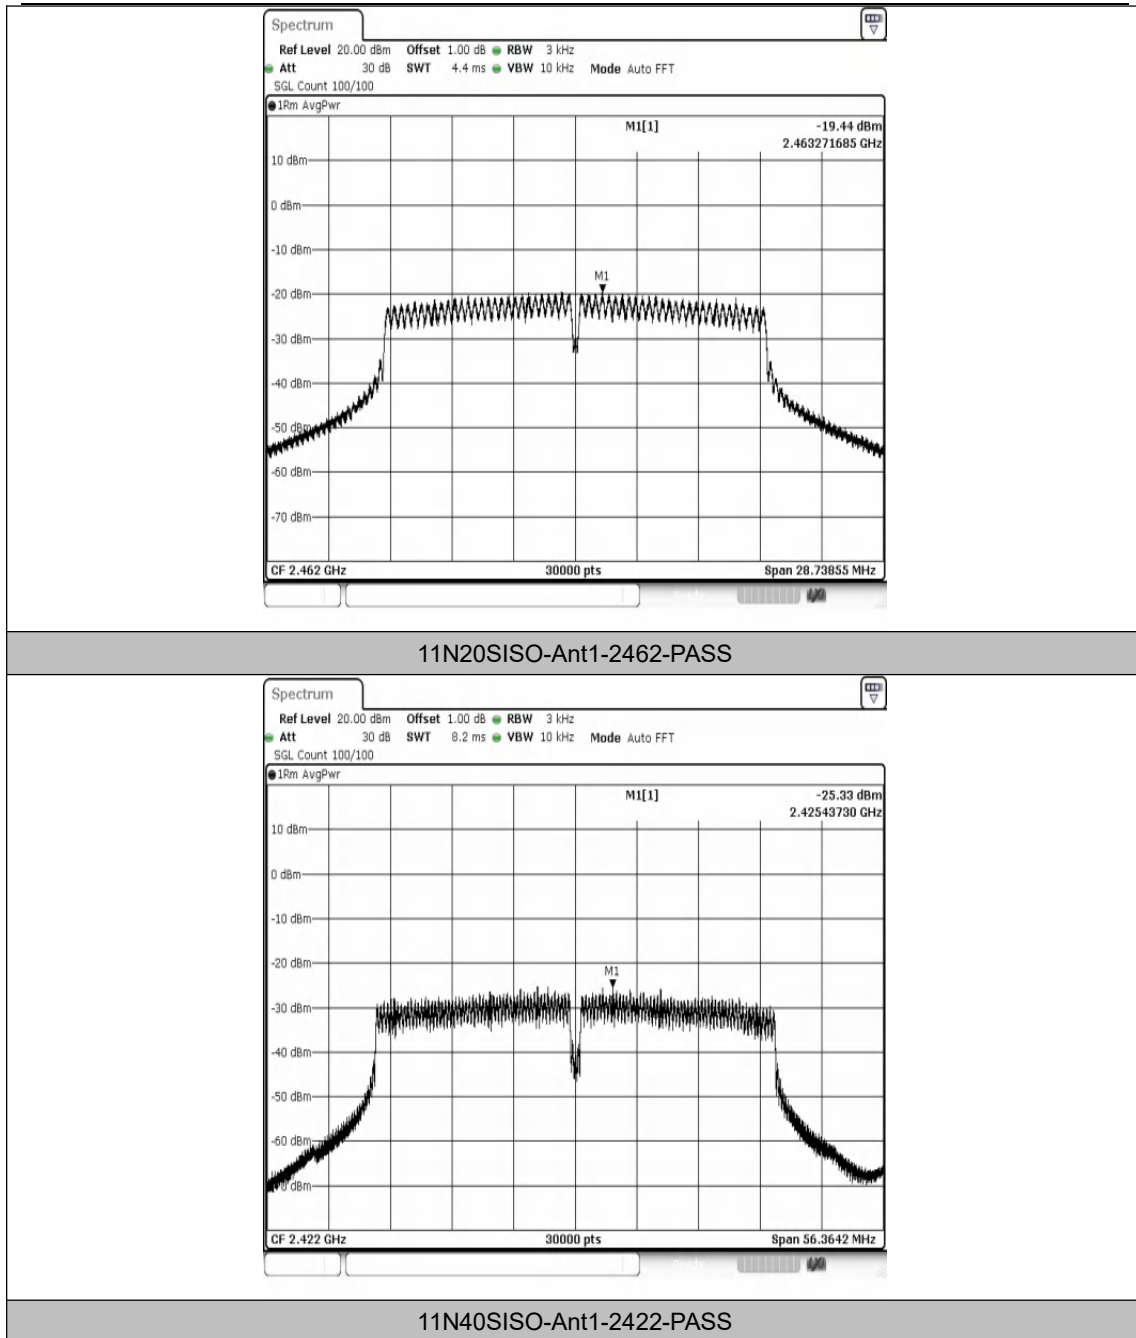


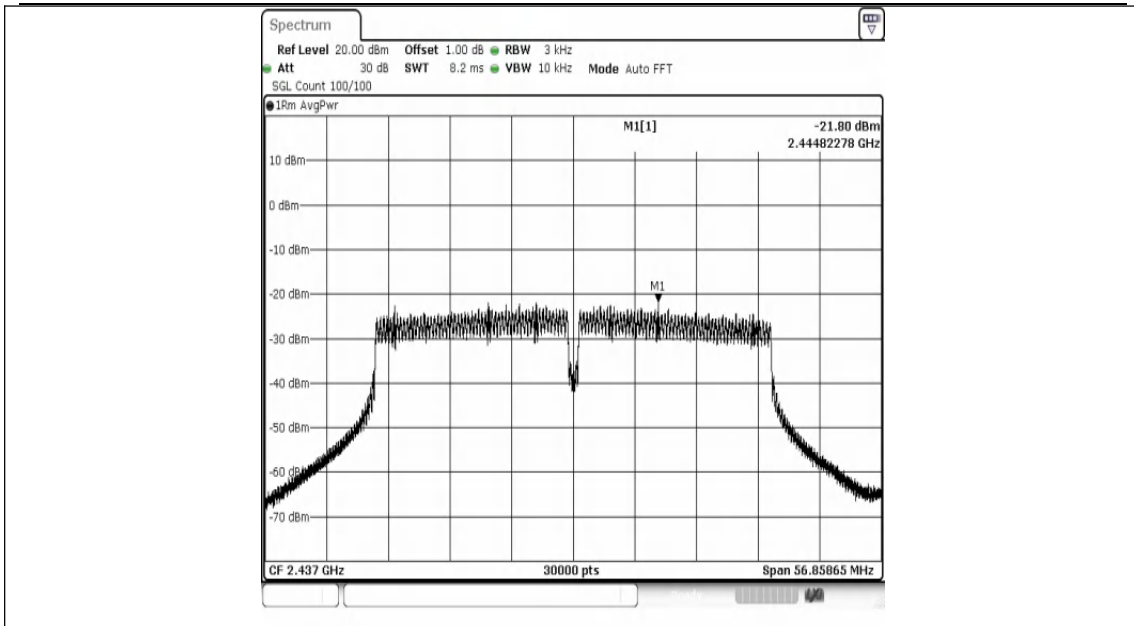


11N40SISO-Ant1-2437-PASS

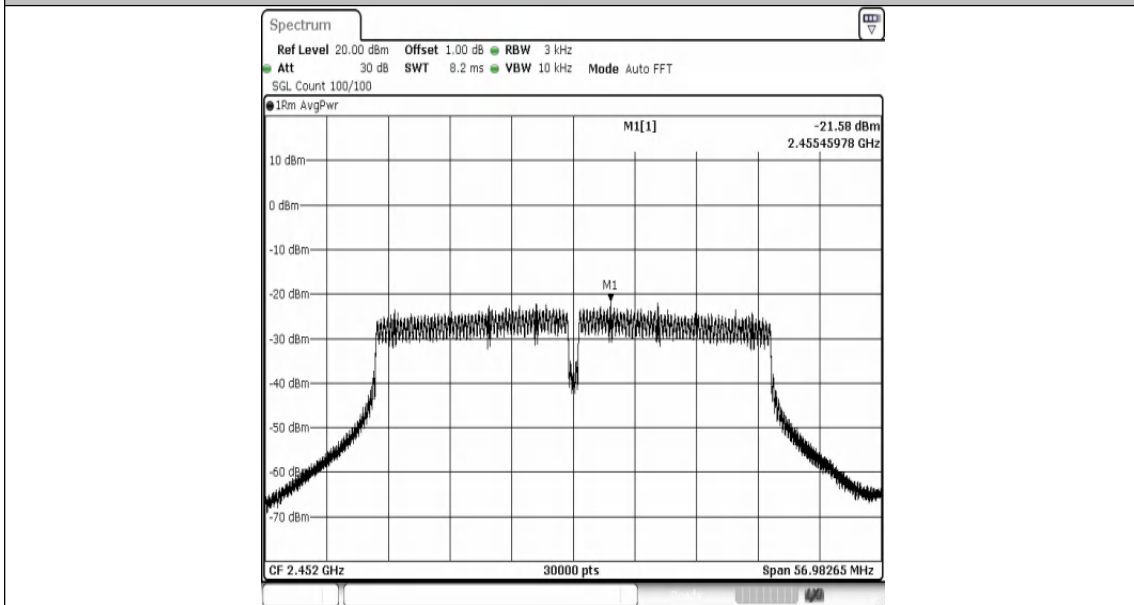

11N40SISO-Ant1-2452-PASS

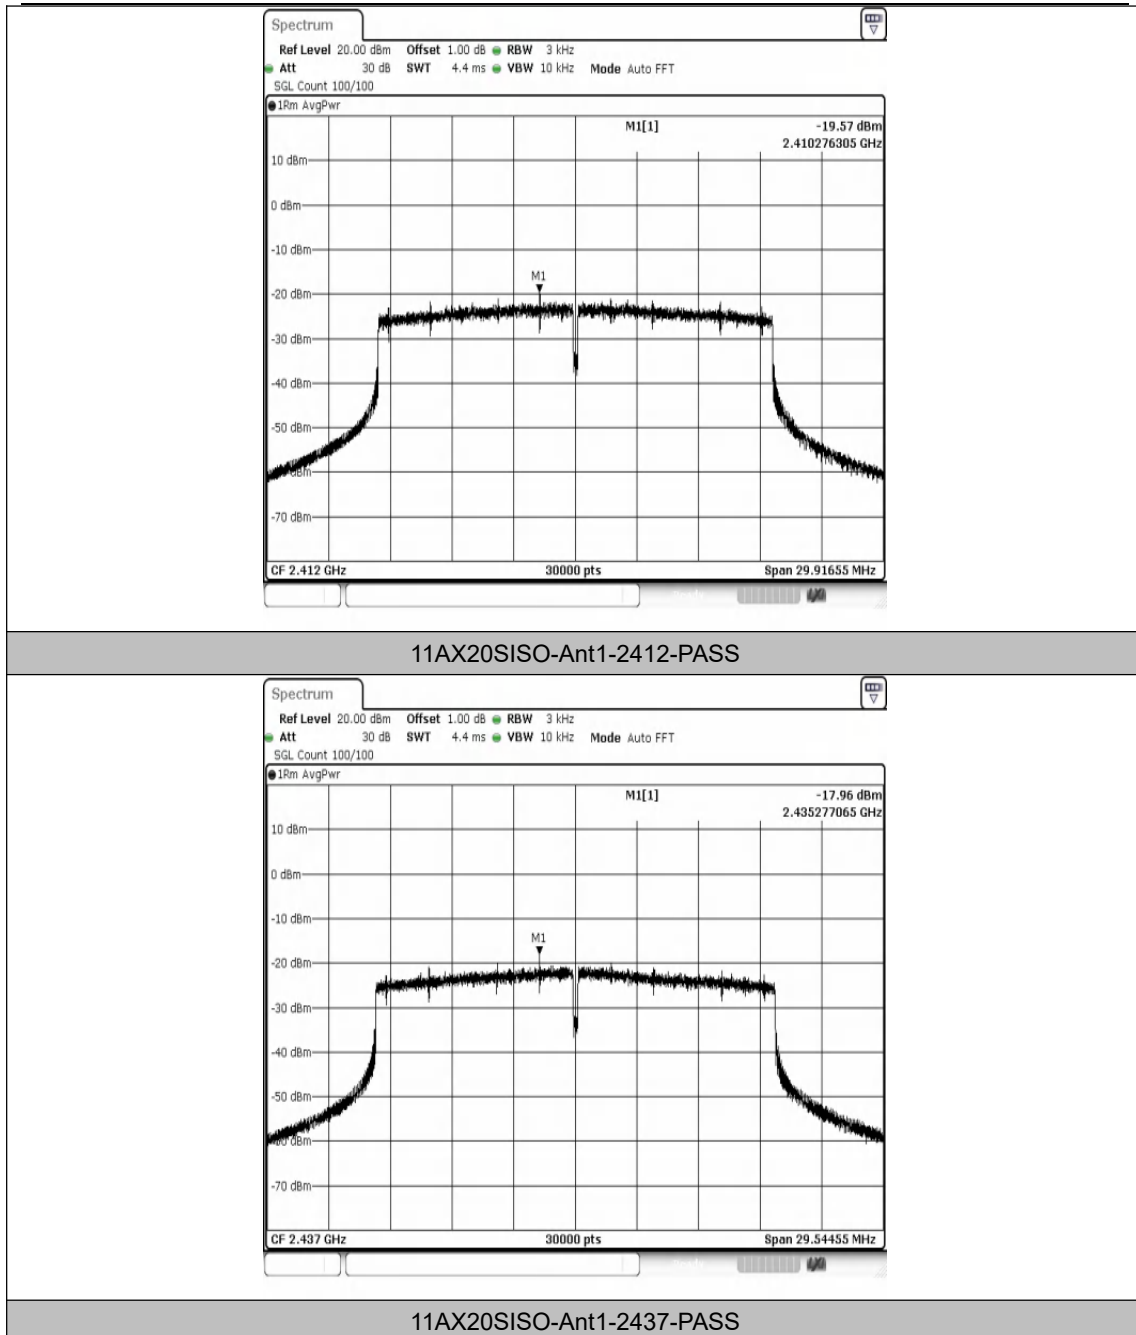


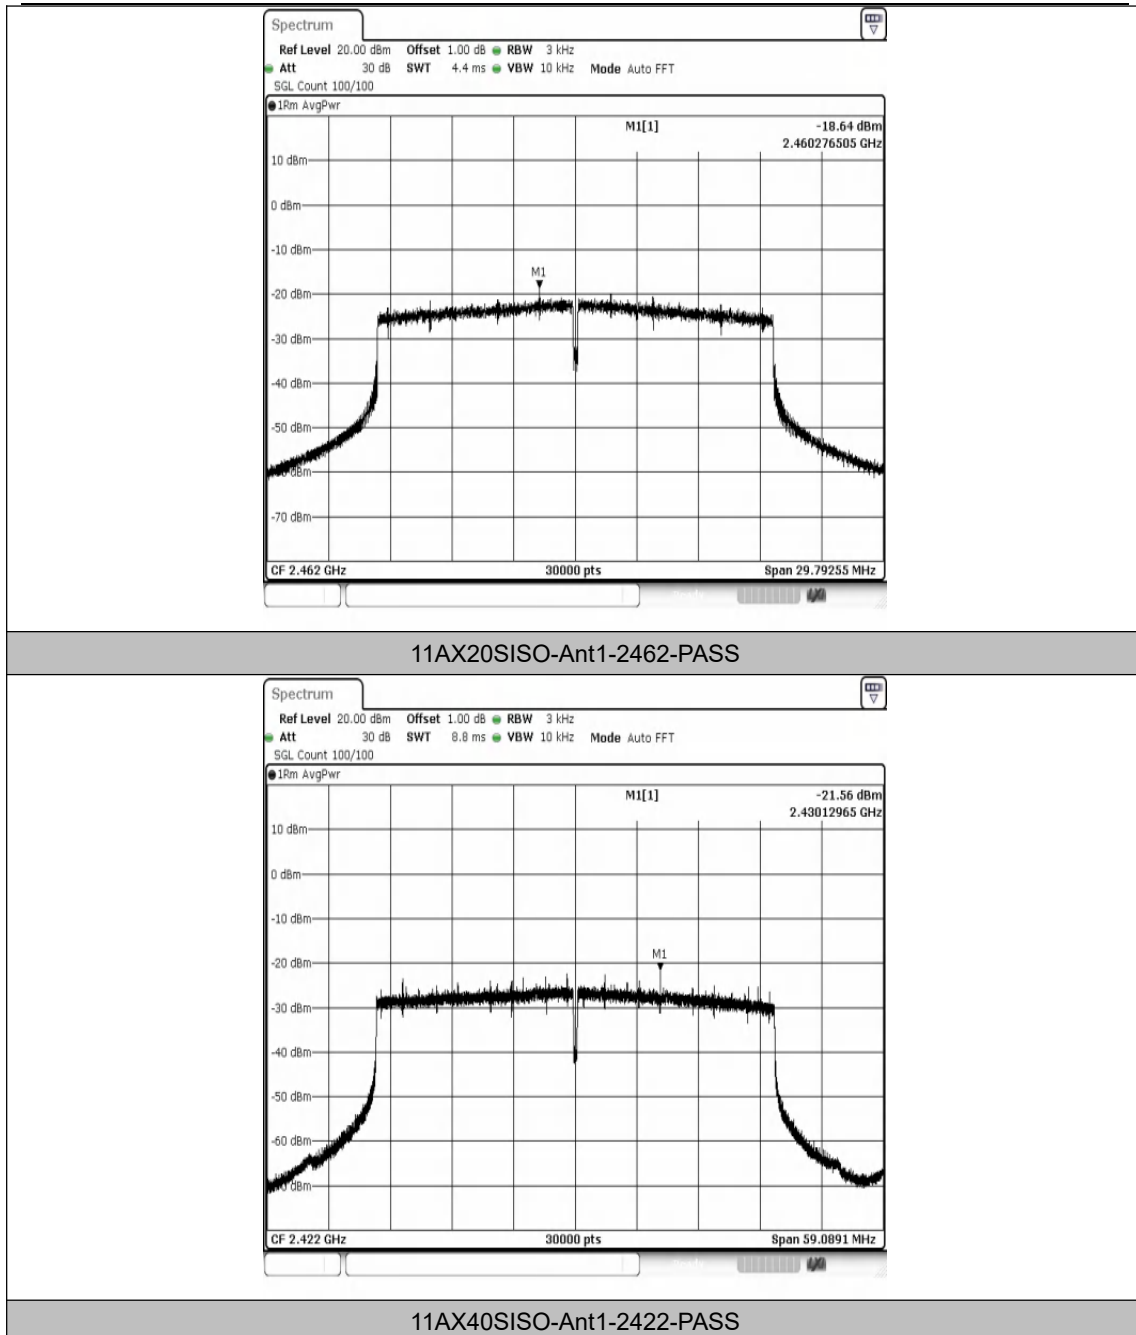

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

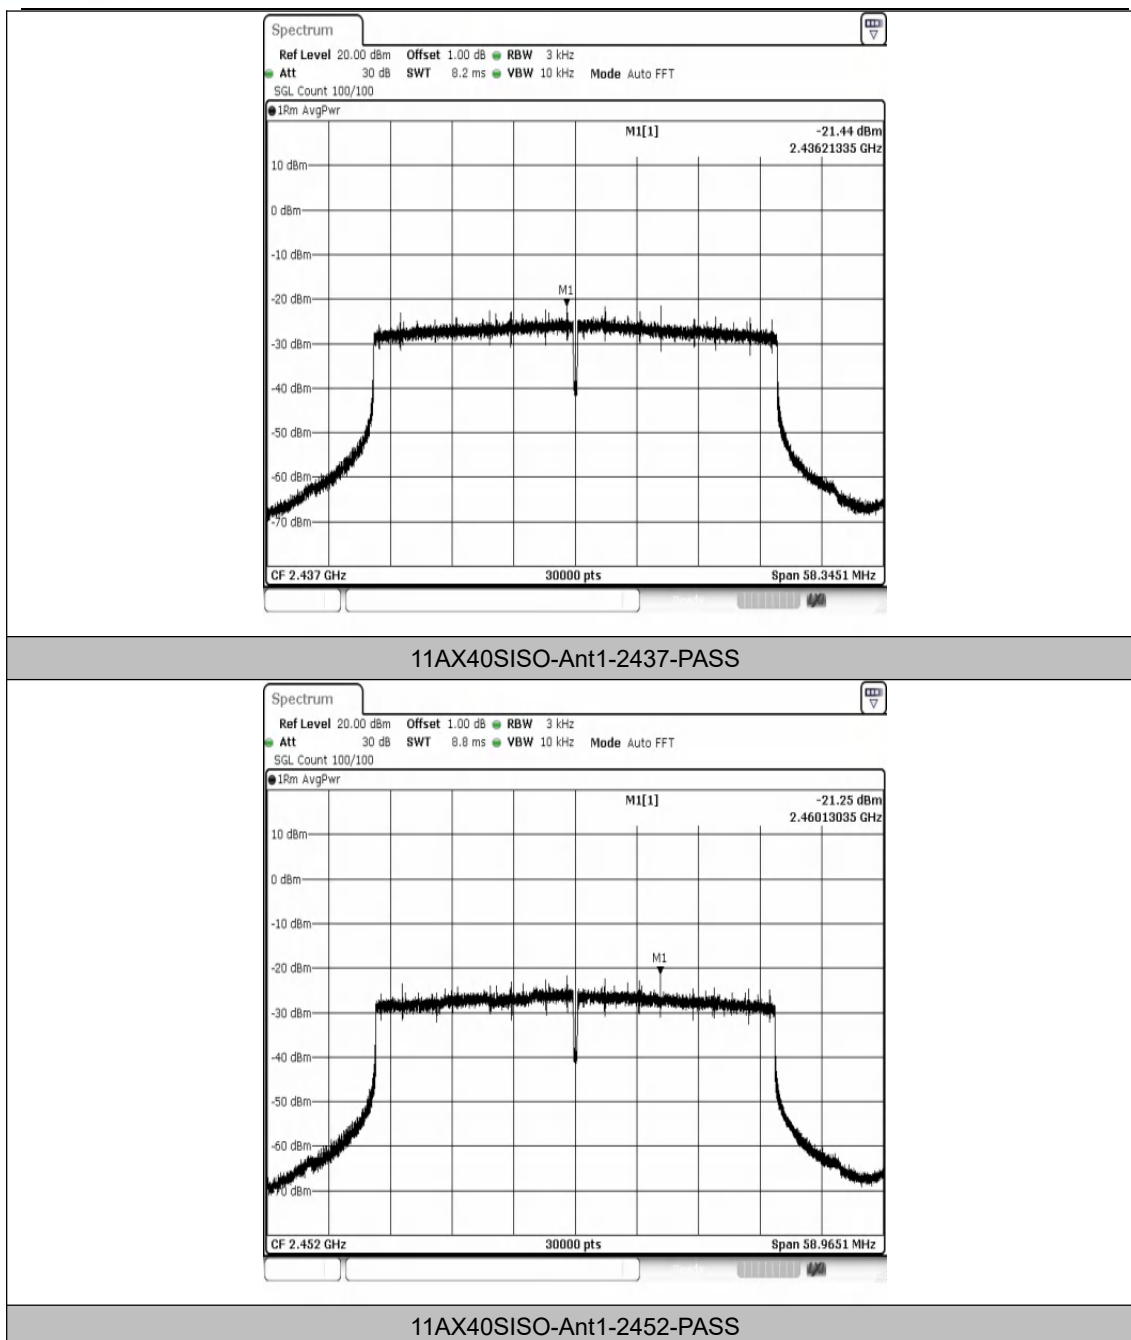

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Appendix E: Conducted Band edge

Test Result


Test Mode	Antenna	Ch. Name	Frequency [MHz]	Ref. Level [dBm]	Result [dBm]	Limit [dBm]	Verdict
11B	Ant1	Low	2412	4.36	-41.64	≤-25.64	PASS
11B	Ant1	High	2462	4.37	-54.01	≤-25.63	PASS
11G	Ant1	Low	2412	-3.67	-48.14	≤-33.67	PASS
11G	Ant1	High	2462	3.30	-48.2	≤-26.7	PASS
11N20SISO	Ant1	Low	2412	-4.10	-49.95	≤-34.1	PASS
11N20SISO	Ant1	High	2462	0.94	-44.36	≤-29.06	PASS
11N40SISO	Ant1	Low	2422	-7.15	-47.23	≤-37.15	PASS
11N40SISO	Ant1	High	2452	0.61	-45.16	≤-29.39	PASS
11AX20SISO	Ant1	Low	2412	-5.00	-46.43	≤-35	PASS
11AX20SISO	Ant1	High	2462	0.05	-45.61	≤-29.95	PASS
11AX40SISO	Ant1	Low	2422	-0.02	-34.27	≤-30.02	PASS
11AX40SISO	Ant1	High	2452	0.06	-44.39	≤-29.94	PASS

Test Graphs

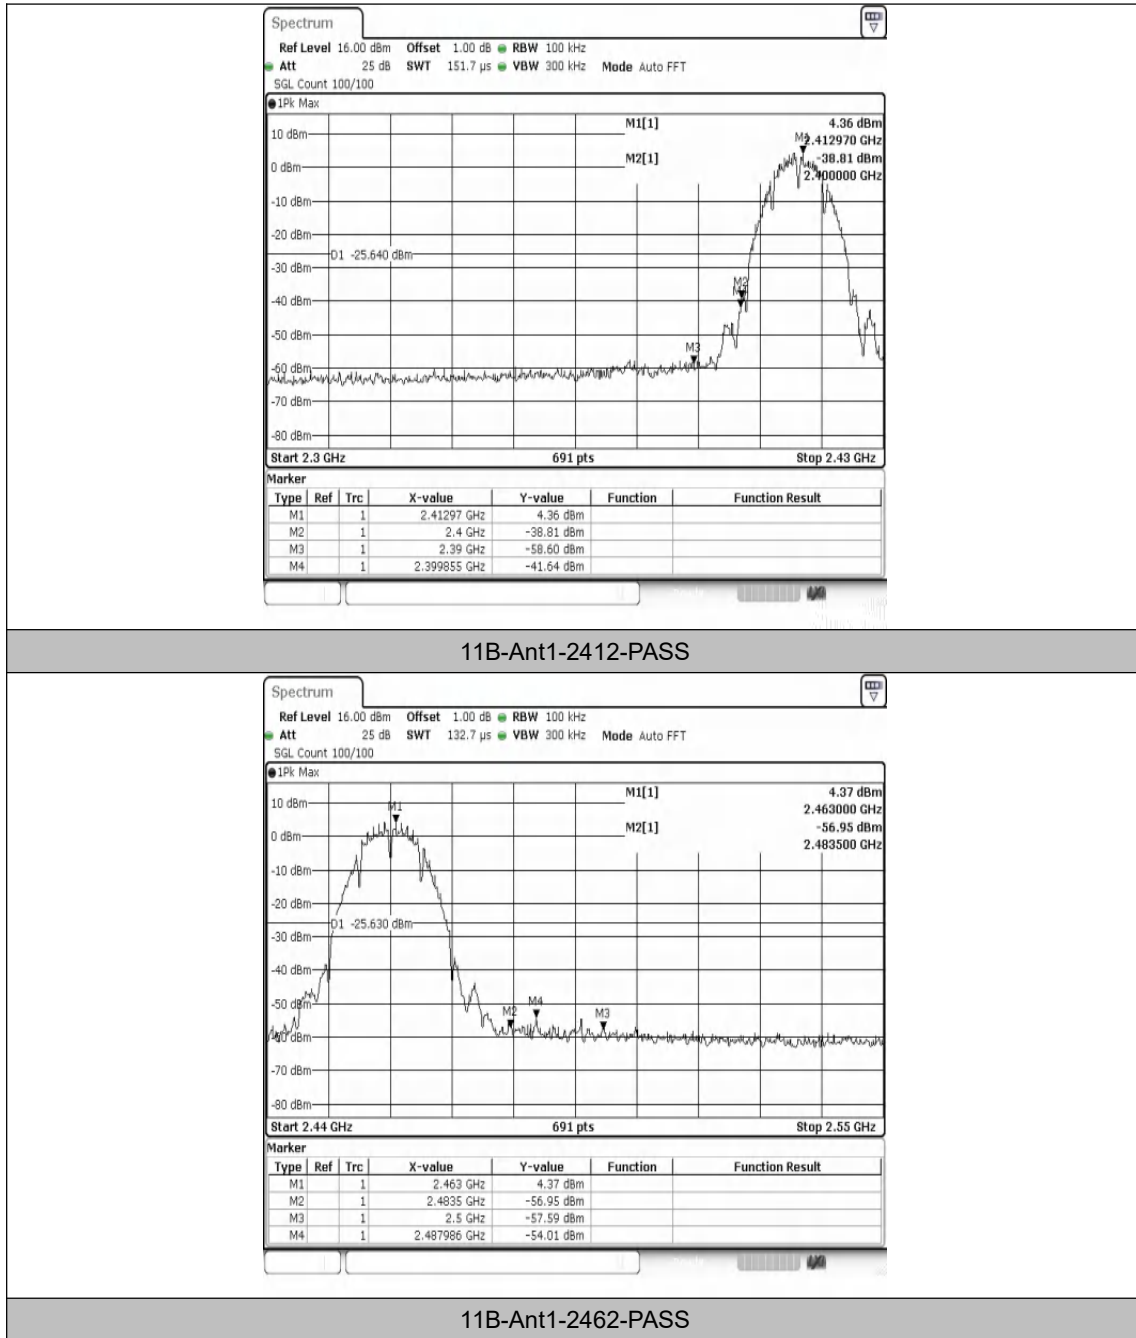


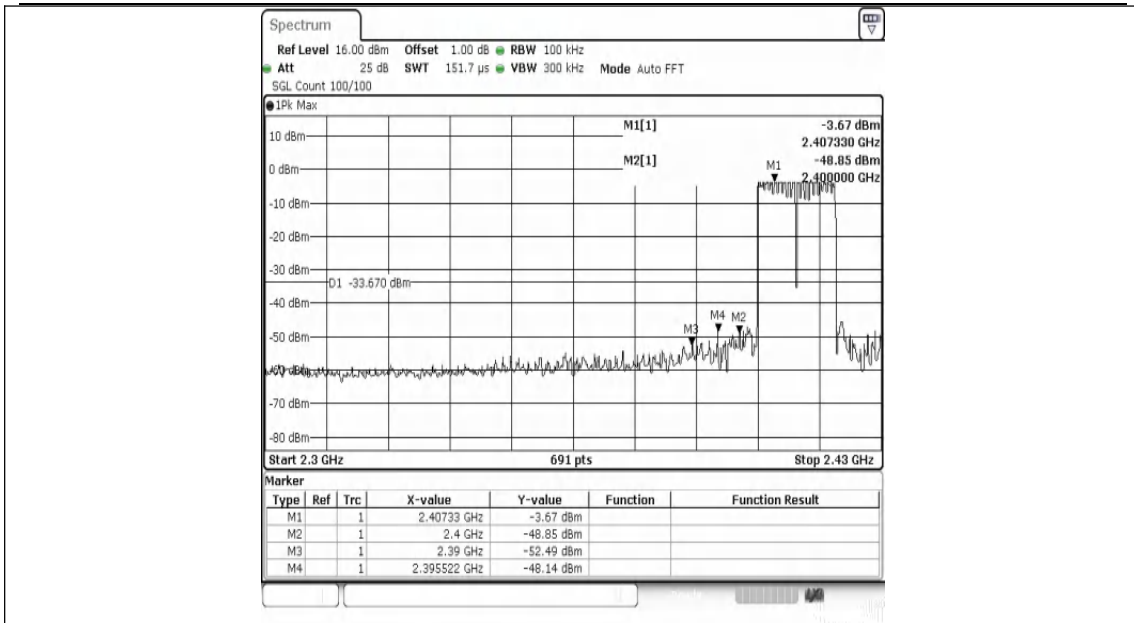



11G-Ant1-2412-PASS

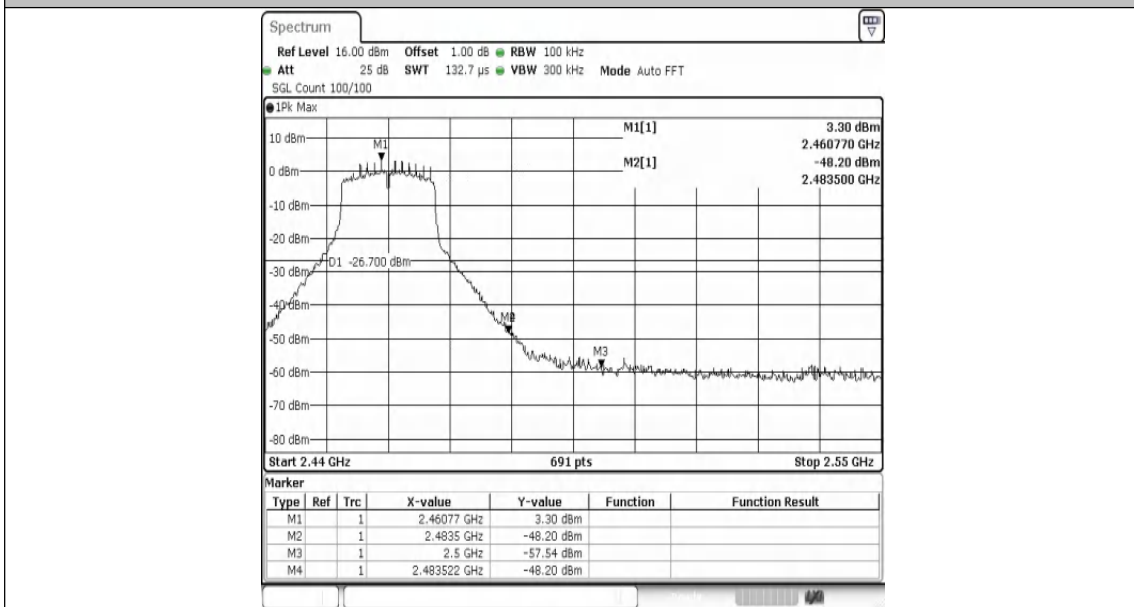


11G-Ant1-2462-PASS

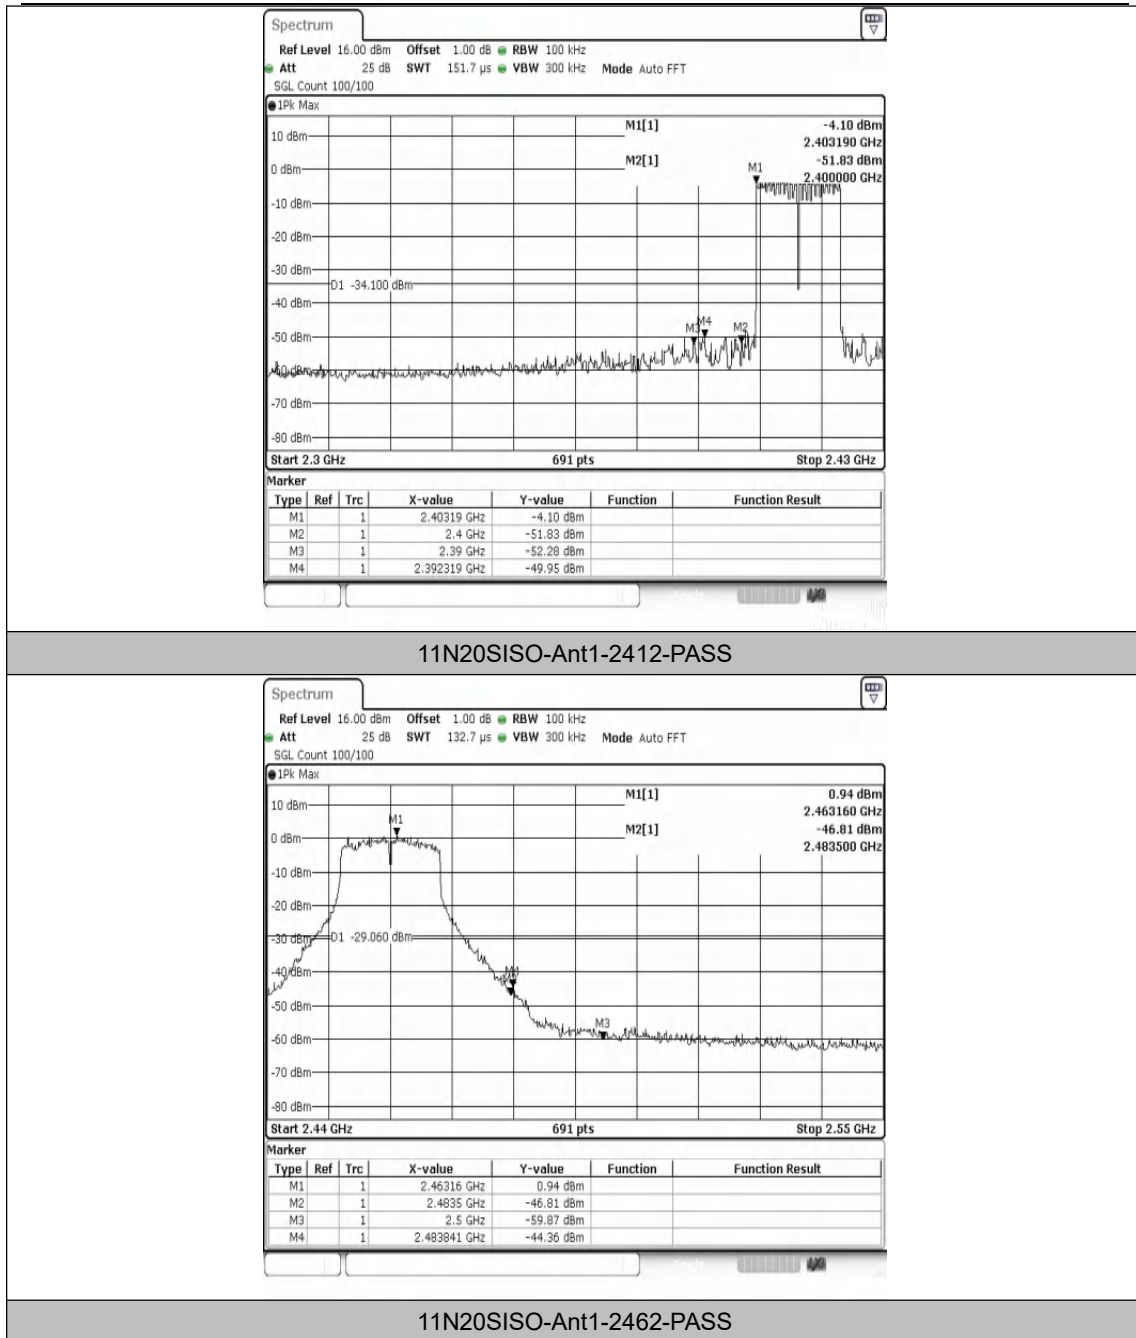


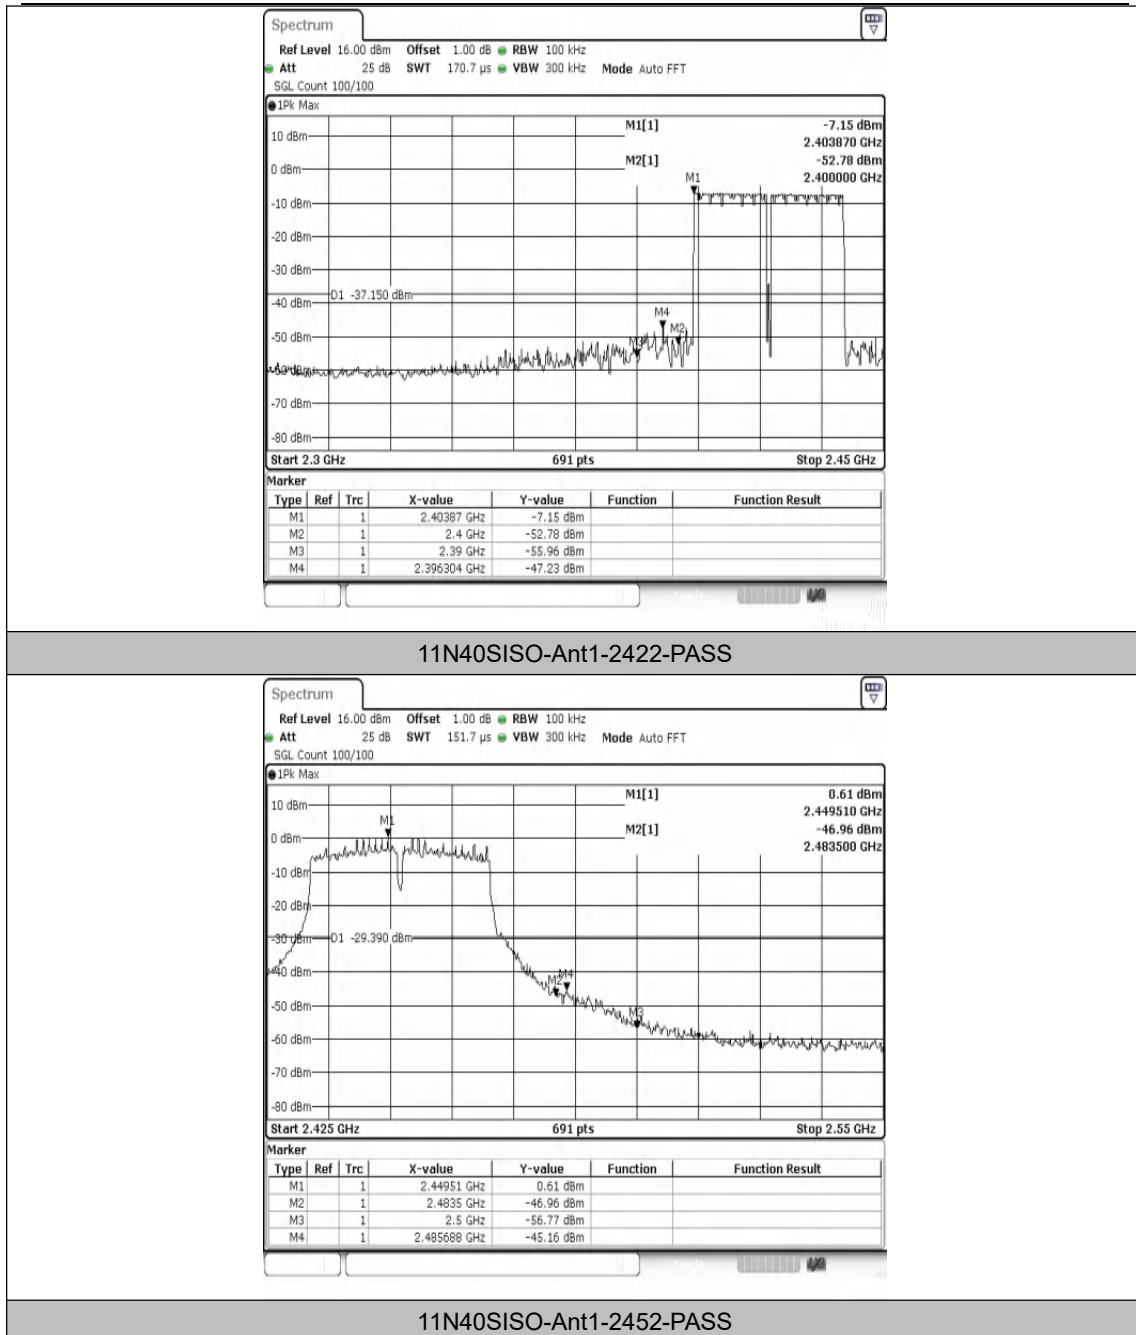

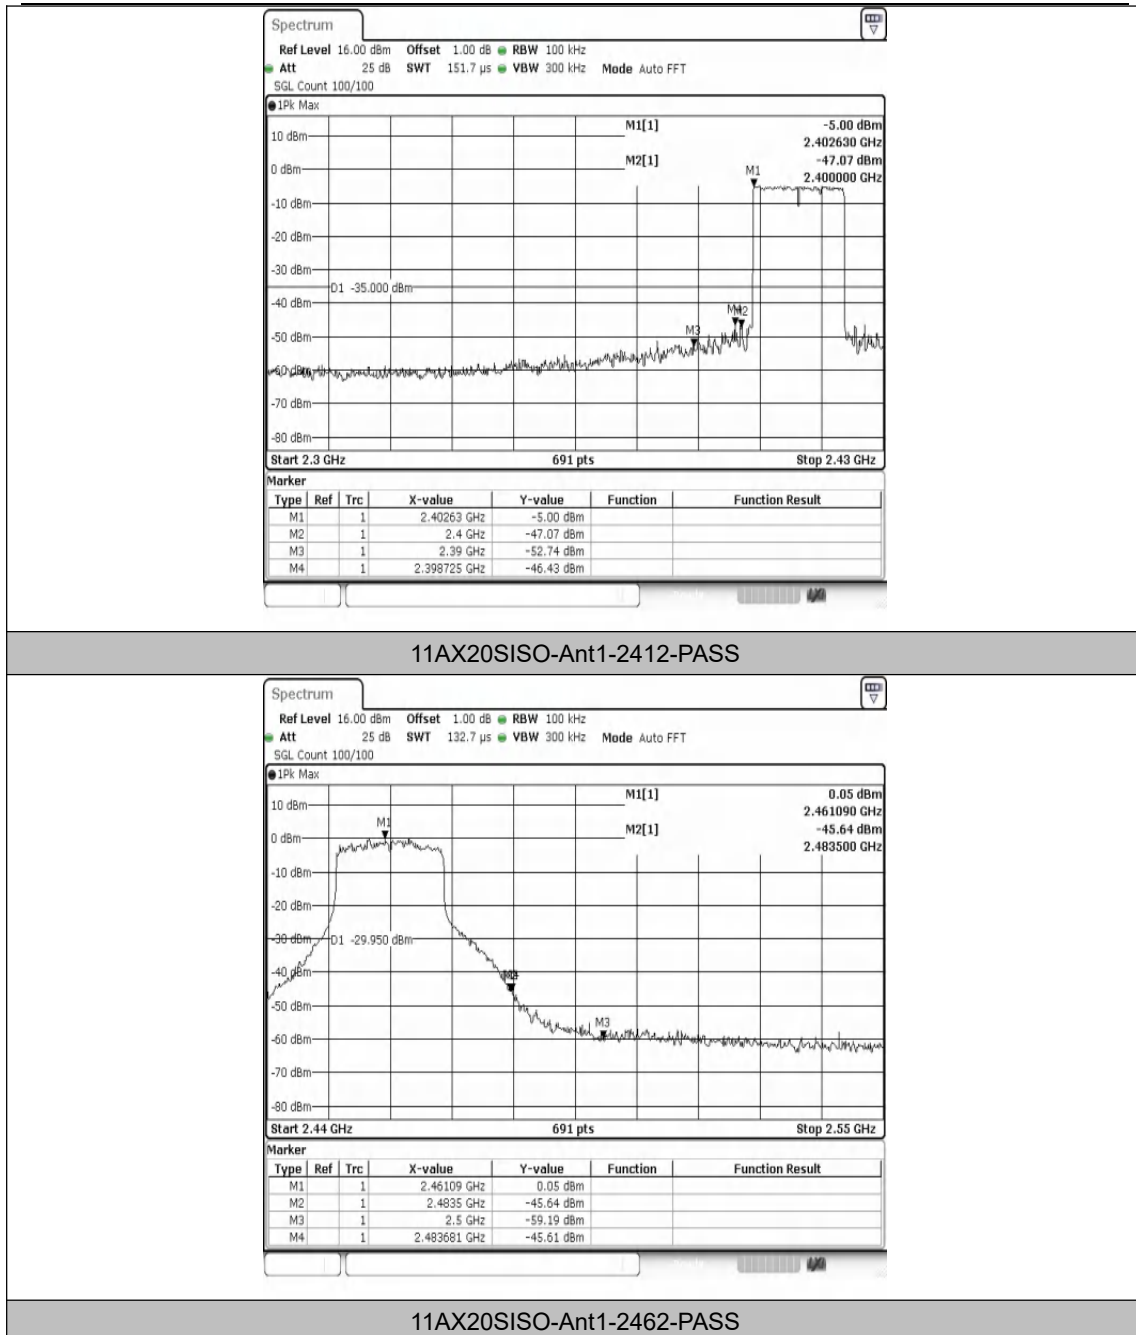

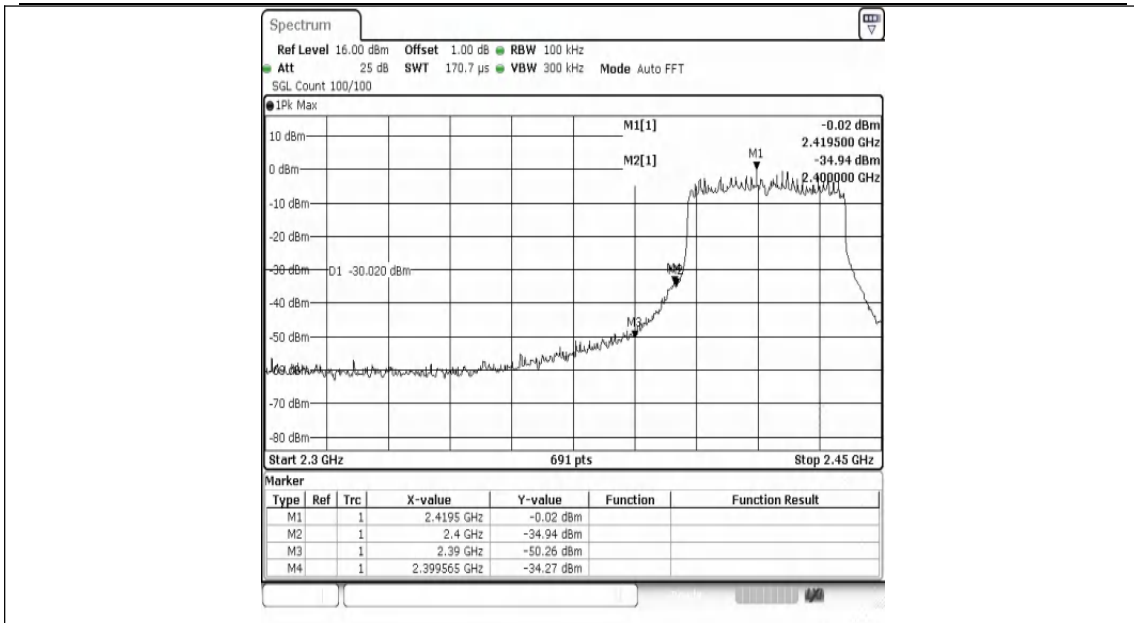

11AX40SISO-Ant1-2422-PASS

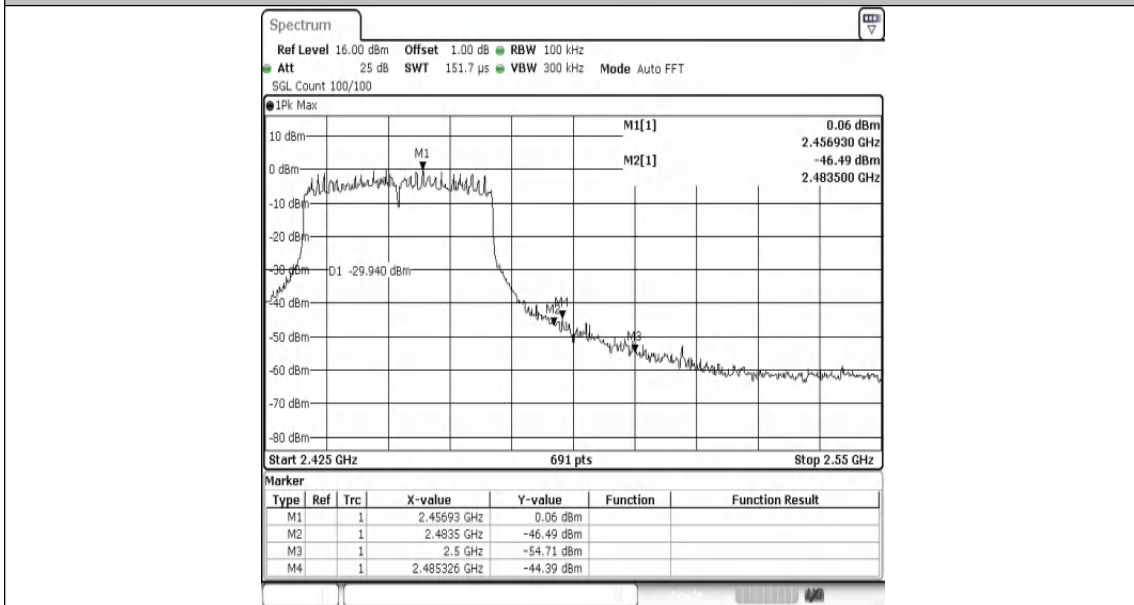

11AX40SISO-Ant1-2452-PASS

Appendix F: Conducted Spurious Emission

Test Result

Test Mode	Antenna	Frequency[MHz]	Freq. Range [Mhz]	Ref. Level [dBm]	Result [dBm]	Limit [dBm]	Verdict
11B	Ant1	2412	0~Reference	4.50	4.50	---	PASS
11B	Ant1	2412	30~1000	4.50	-50.57	≤-25.5	PASS
11B	Ant1	2412	1000~26500	4.50	-37.56	≤-25.5	PASS
11B	Ant1	2437	0~Reference	2.36	2.36	---	PASS
11B	Ant1	2437	30~1000	2.36	-51.53	≤-27.64	PASS
11B	Ant1	2437	1000~26500	2.36	-38.41	≤-27.64	PASS
11B	Ant1	2462	0~Reference	3.69	3.69	---	PASS
11B	Ant1	2462	30~1000	3.69	-53.31	≤-26.31	PASS
11B	Ant1	2462	1000~26500	3.69	-39.46	≤-26.31	PASS
11G	Ant1	2412	0~Reference	3.05	3.05	---	PASS
11G	Ant1	2412	30~1000	3.05	-51.66	≤-26.95	PASS
11G	Ant1	2412	1000~26500	3.05	-44.54	≤-26.95	PASS
11G	Ant1	2437	0~Reference	2.15	2.15	---	PASS
11G	Ant1	2437	30~1000	2.15	-52.2	≤-27.85	PASS
11G	Ant1	2437	1000~26500	2.15	-43.15	≤-27.85	PASS
11G	Ant1	2462	0~Reference	3.46	3.46	---	PASS
11G	Ant1	2462	30~1000	3.46	-48.67	≤-26.54	PASS
11G	Ant1	2462	1000~26500	3.46	-44.04	≤-26.54	PASS
11N20SISO	Ant1	2412	0~Reference	3.02	3.02	---	PASS
11N20SISO	Ant1	2412	30~1000	3.02	-50.81	≤-26.98	PASS
11N20SISO	Ant1	2412	1000~26500	3.02	-43.41	≤-26.98	PASS
11N20SISO	Ant1	2437	0~Reference	0.65	0.65	---	PASS
11N20SISO	Ant1	2437	30~1000	0.65	-50.66	≤-29.35	PASS
11N20SISO	Ant1	2437	1000~26500	0.65	-43.96	≤-29.35	PASS
11N20SISO	Ant1	2462	0~Reference	3.07	3.07	---	PASS
11N20SISO	Ant1	2462	30~1000	3.07	-49.08	≤-26.93	PASS
11N20SISO	Ant1	2462	1000~26500	3.07	-44.43	≤-26.93	PASS
11N40SISO	Ant1	2422	0~Reference	-2.44	-2.44	---	PASS
11N40SISO	Ant1	2422	30~1000	-2.44	-49.86	≤-32.44	PASS
11N40SISO	Ant1	2422	1000~26500	-2.44	-43.92	≤-32.44	PASS
11N40SISO	Ant1	2437	0~Reference	-1.03	-1.03	---	PASS
11N40SISO	Ant1	2437	30~1000	-1.03	-49.89	≤-31.03	PASS
11N40SISO	Ant1	2437	1000~26500	-1.03	-44.57	≤-31.03	PASS
11N40SISO	Ant1	2452	0~Reference	-1.58	-1.58	---	PASS
11N40SISO	Ant1	2452	30~1000	-1.58	-52.21	≤-31.58	PASS
11N40SISO	Ant1	2452	1000~26500	-1.58	-44.05	≤-31.58	PASS

Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

11AX20SISO	Ant1	2412	0~Reference	2.87	2.87	---	PASS
11AX20SISO	Ant1	2412	30~1000	2.87	-51.12	≤-27.13	PASS
11AX20SISO	Ant1	2412	1000~26500	2.87	-43.88	≤-27.13	PASS
11AX20SISO	Ant1	2437	0~Reference	1.47	1.47	---	PASS
11AX20SISO	Ant1	2437	30~1000	1.47	-52.94	≤-28.53	PASS
11AX20SISO	Ant1	2437	1000~26500	1.47	-43.06	≤-28.53	PASS
11AX20SISO	Ant1	2462	0~Reference	0.17	0.17	---	PASS
11AX20SISO	Ant1	2462	30~1000	0.17	-50.31	≤-29.83	PASS
11AX20SISO	Ant1	2462	1000~26500	0.17	-41.25	≤-29.83	PASS
11AX40SISO	Ant1	2422	0~Reference	0.04	0.04	---	PASS
11AX40SISO	Ant1	2422	30~1000	0.04	-52.47	≤-29.96	PASS
11AX40SISO	Ant1	2422	1000~26500	0.04	-43.12	≤-29.96	PASS
11AX40SISO	Ant1	2437	0~Reference	-1.95	-1.95	---	PASS
11AX40SISO	Ant1	2437	30~1000	-1.95	-52.14	≤-31.95	PASS
11AX40SISO	Ant1	2437	1000~26500	-1.95	-42.78	≤-31.95	PASS
11AX40SISO	Ant1	2452	0~Reference	-0.47	-0.47	---	PASS
11AX40SISO	Ant1	2452	30~1000	-0.47	-52.52	≤-30.47	PASS
11AX40SISO	Ant1	2452	1000~26500	-0.47	-44.06	≤-30.47	PASS

Remark:Regarding the spurious emissions from 30MHz to 26.5GHz, the cable lose have been set in the 'TDF' of the Spectrum Analyzer during the test.


Test Graphs

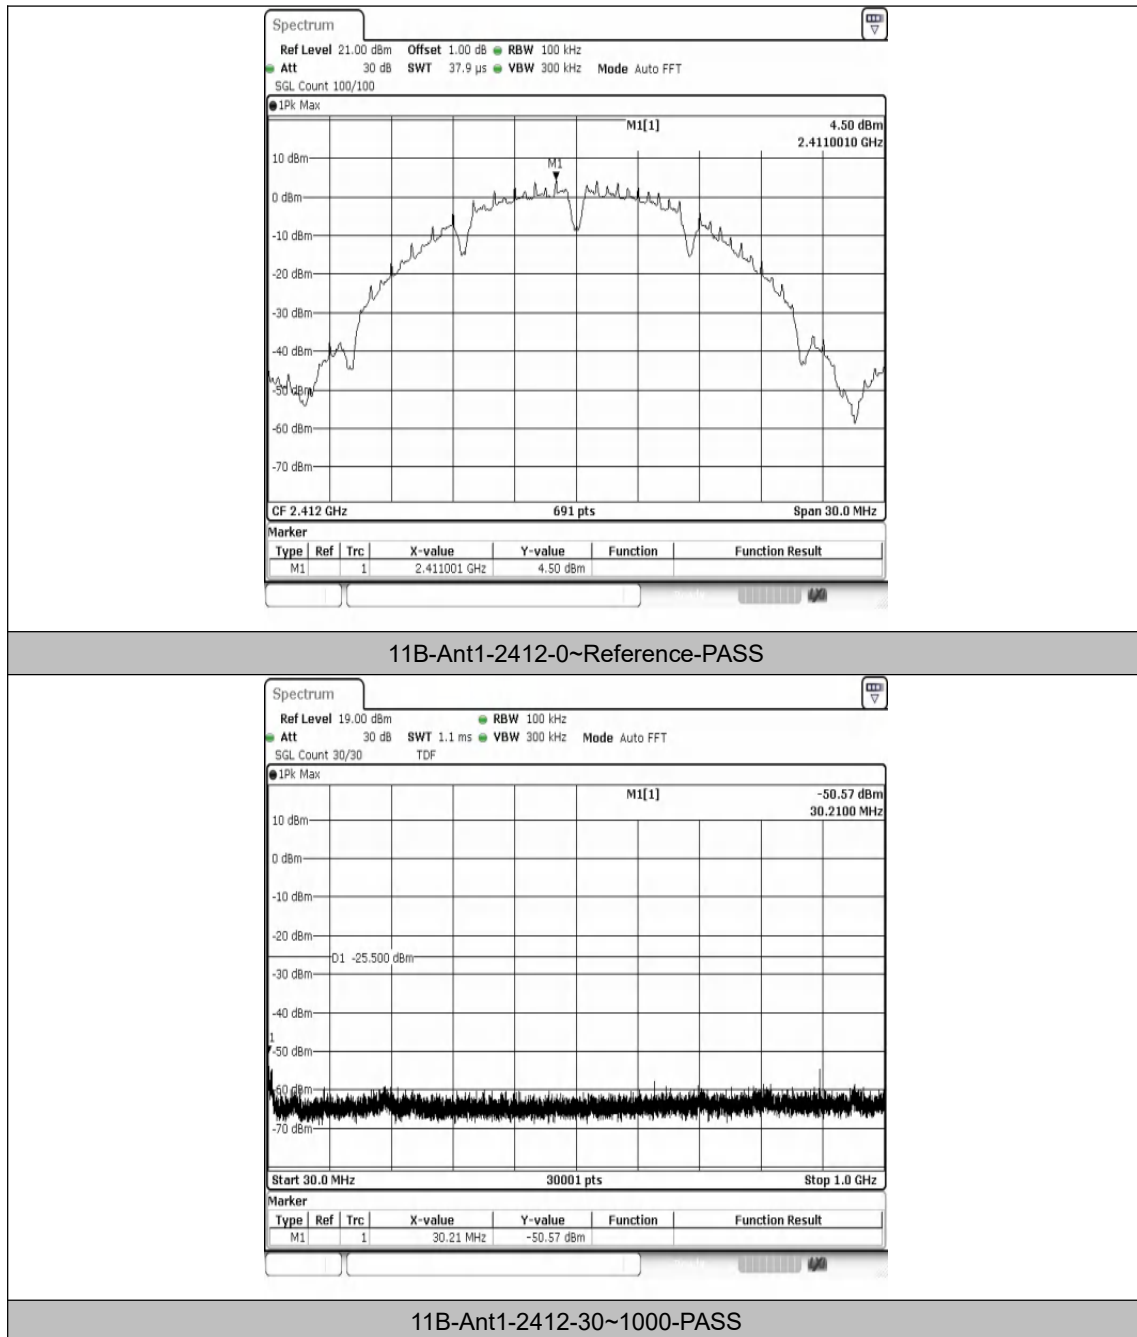

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

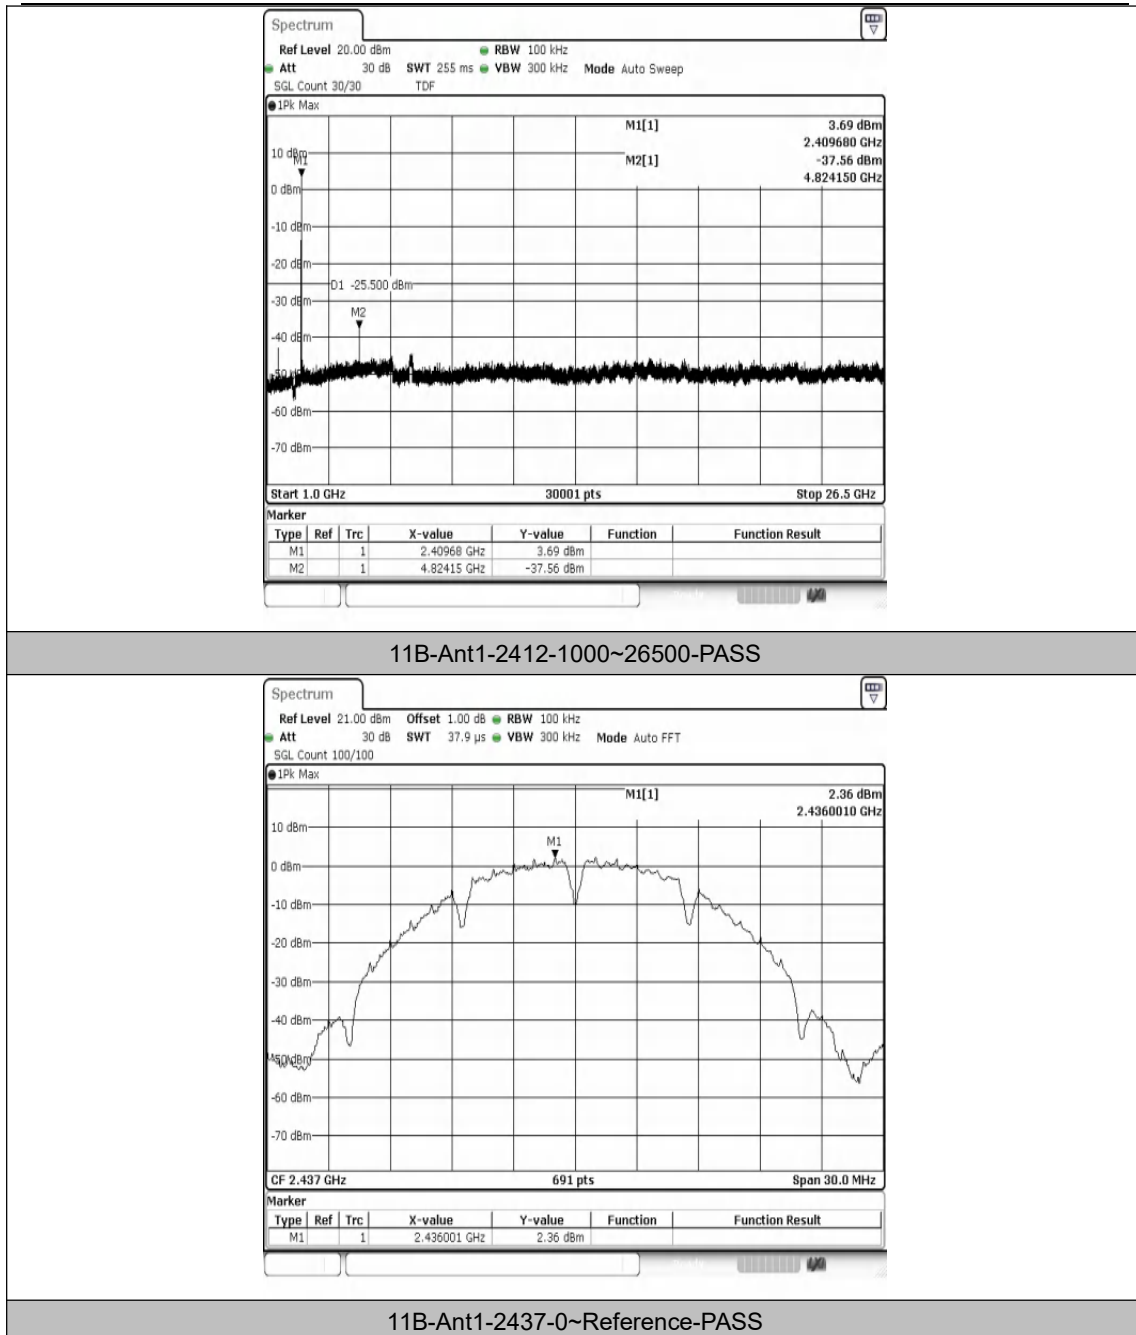


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

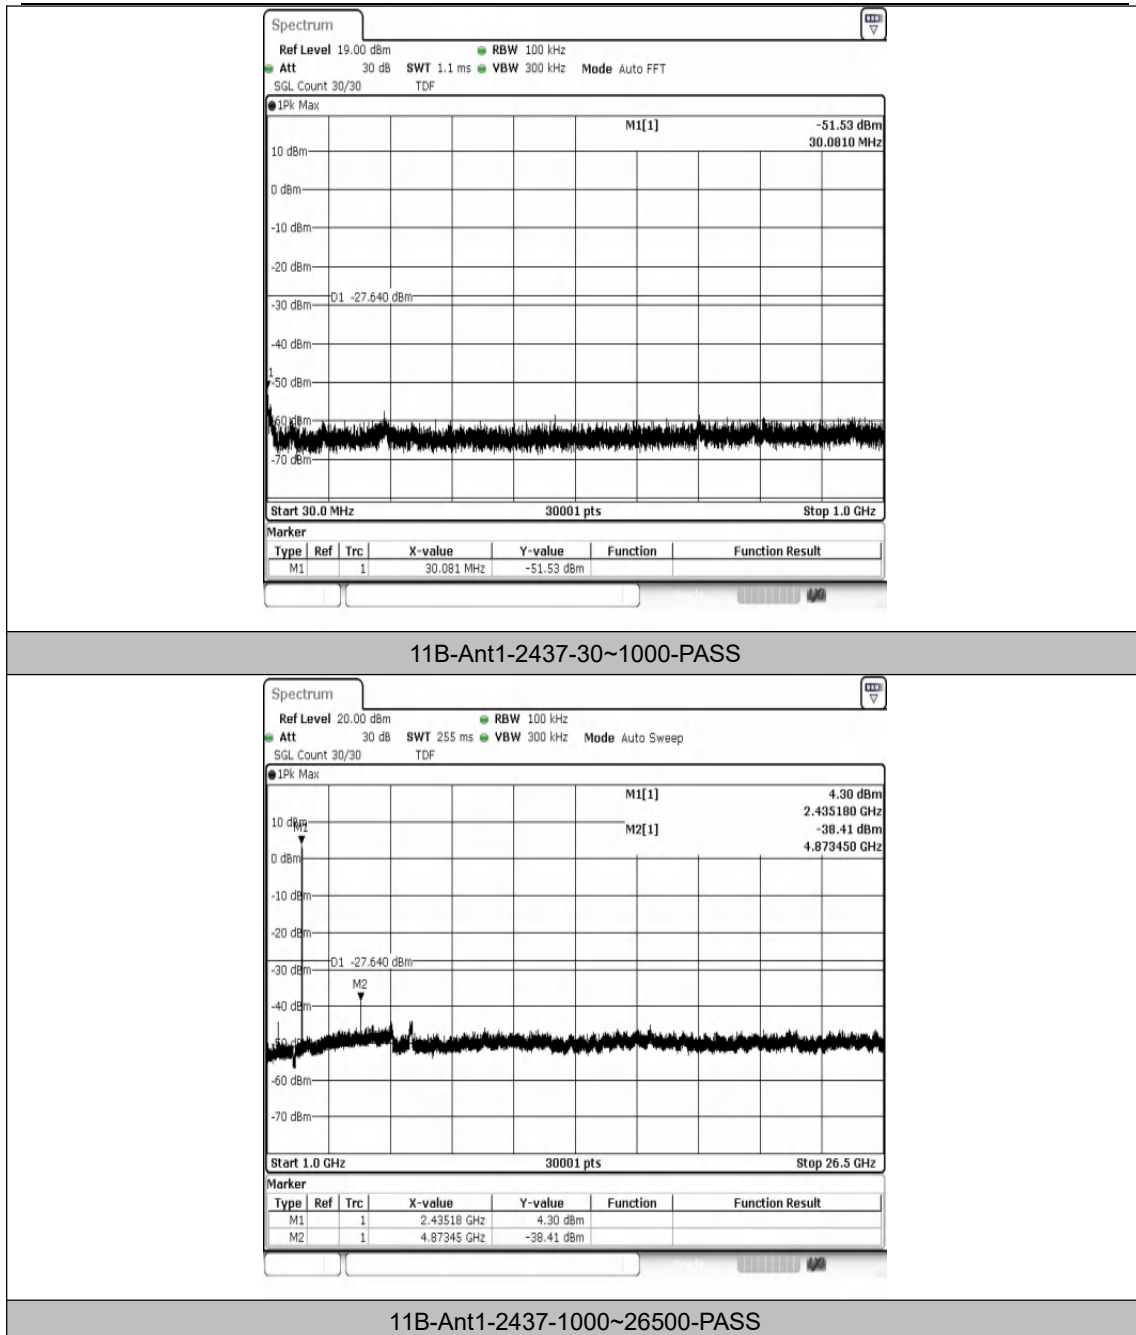


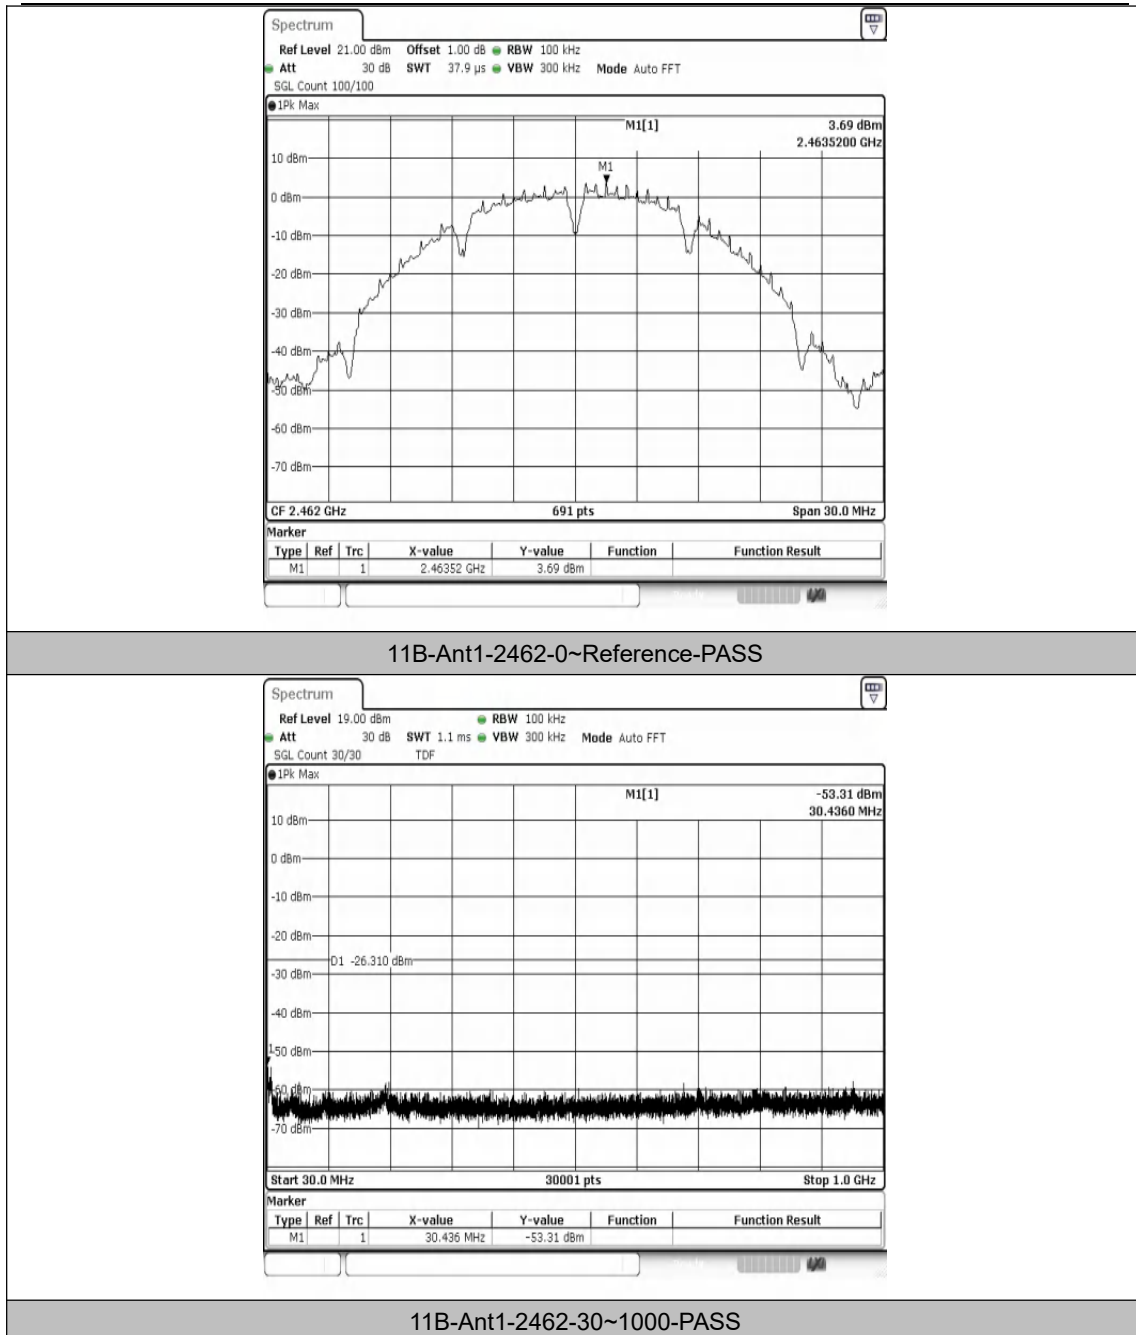

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

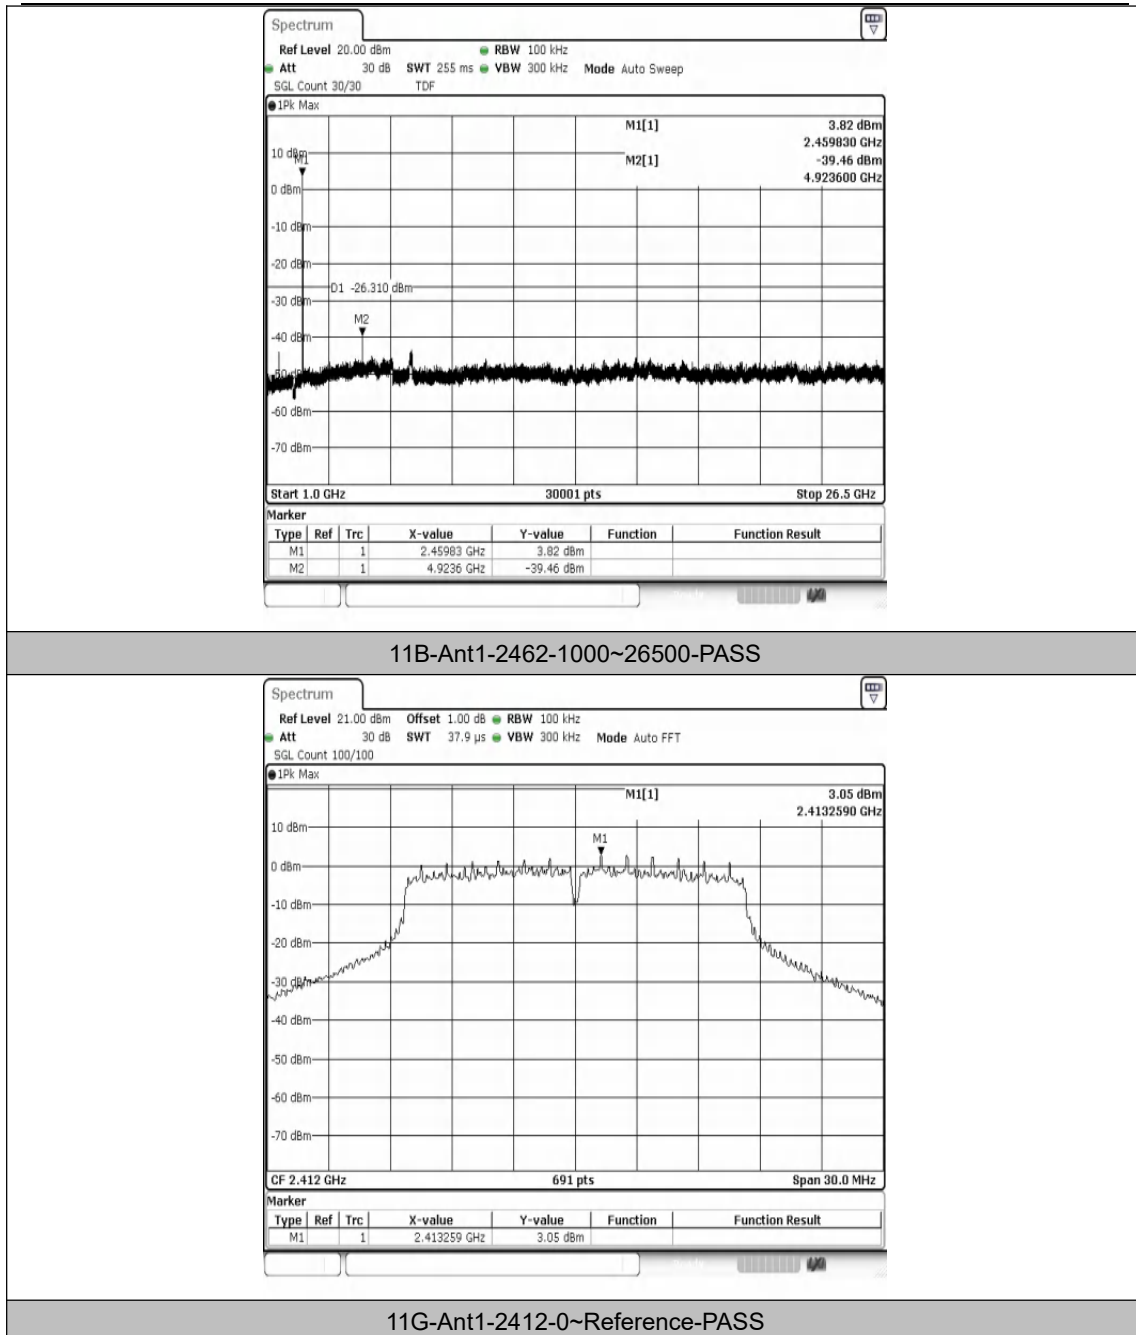


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

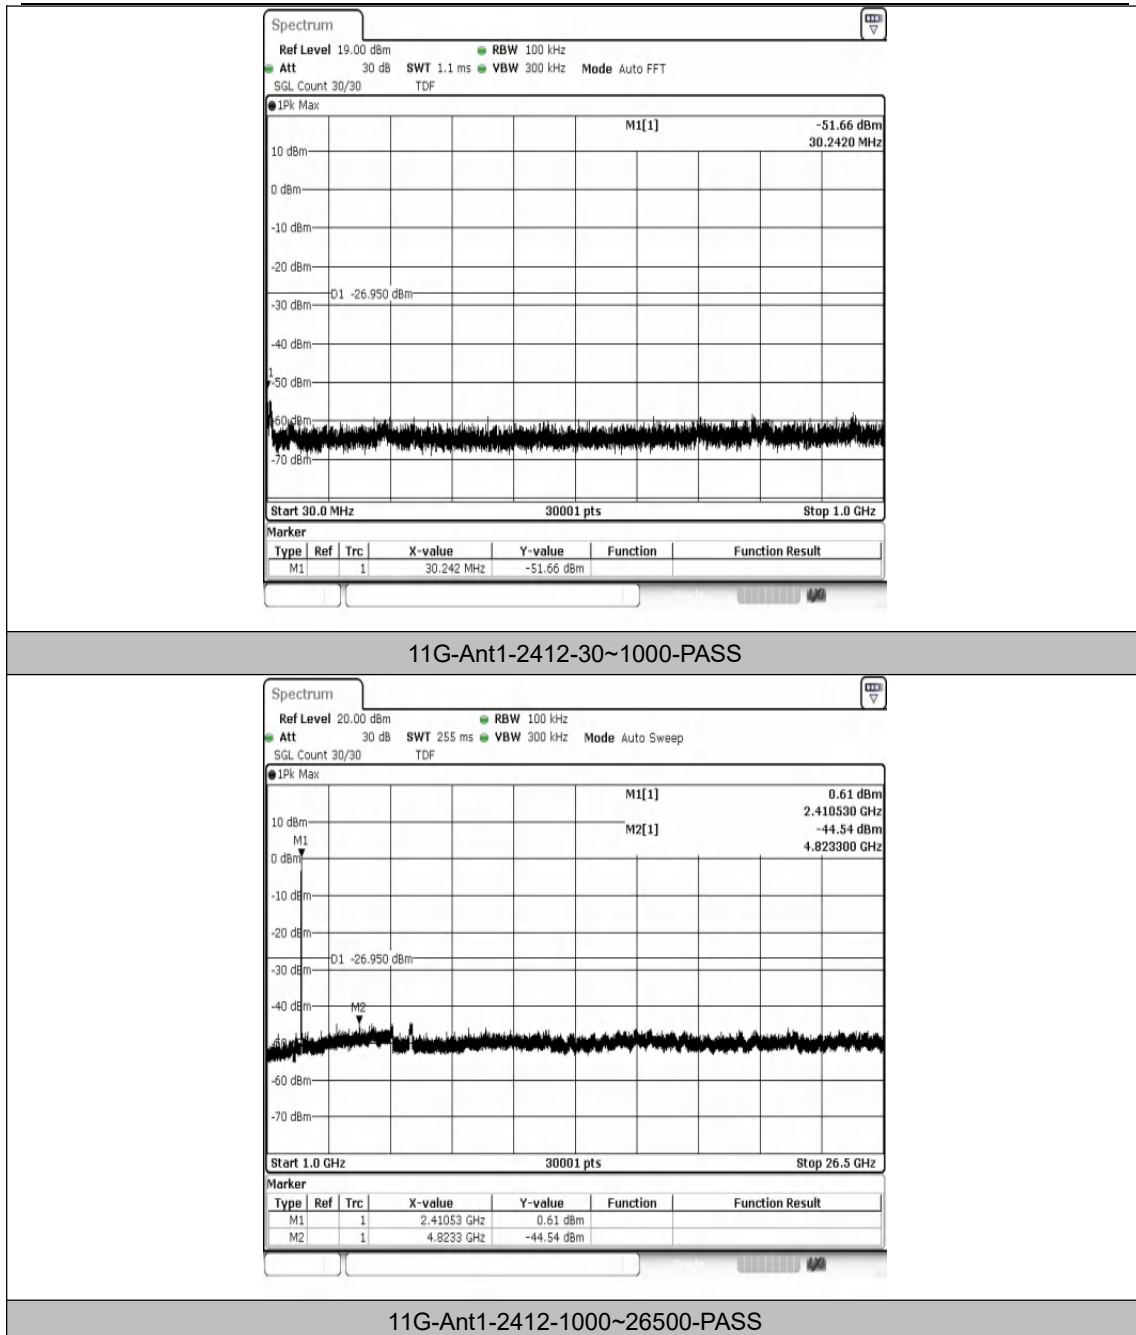


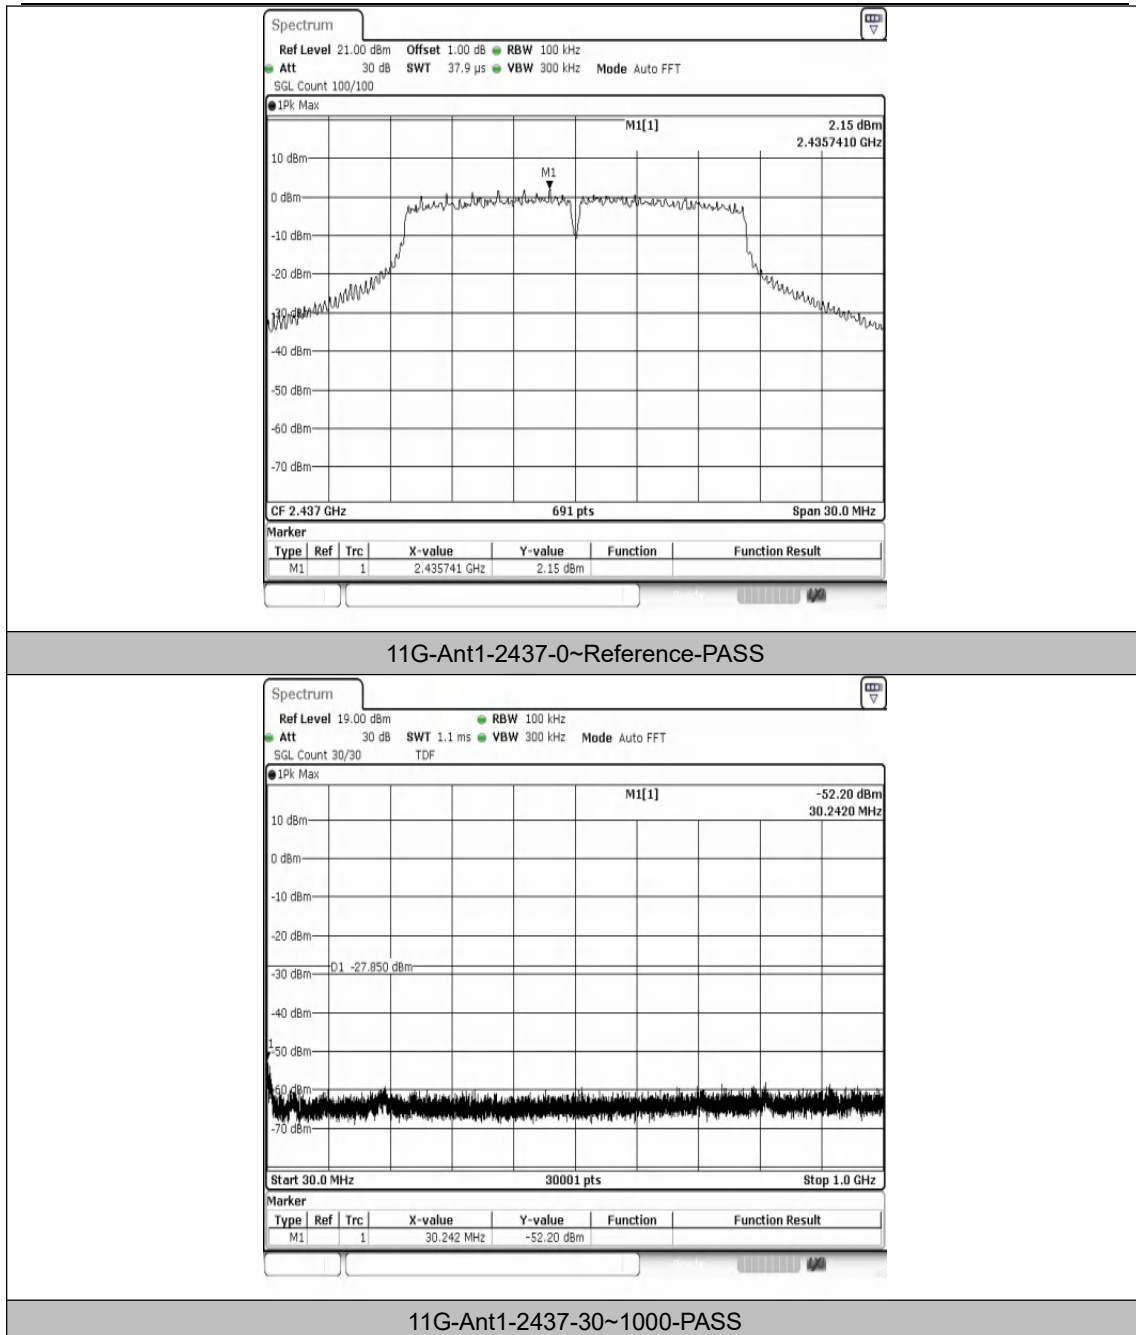

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

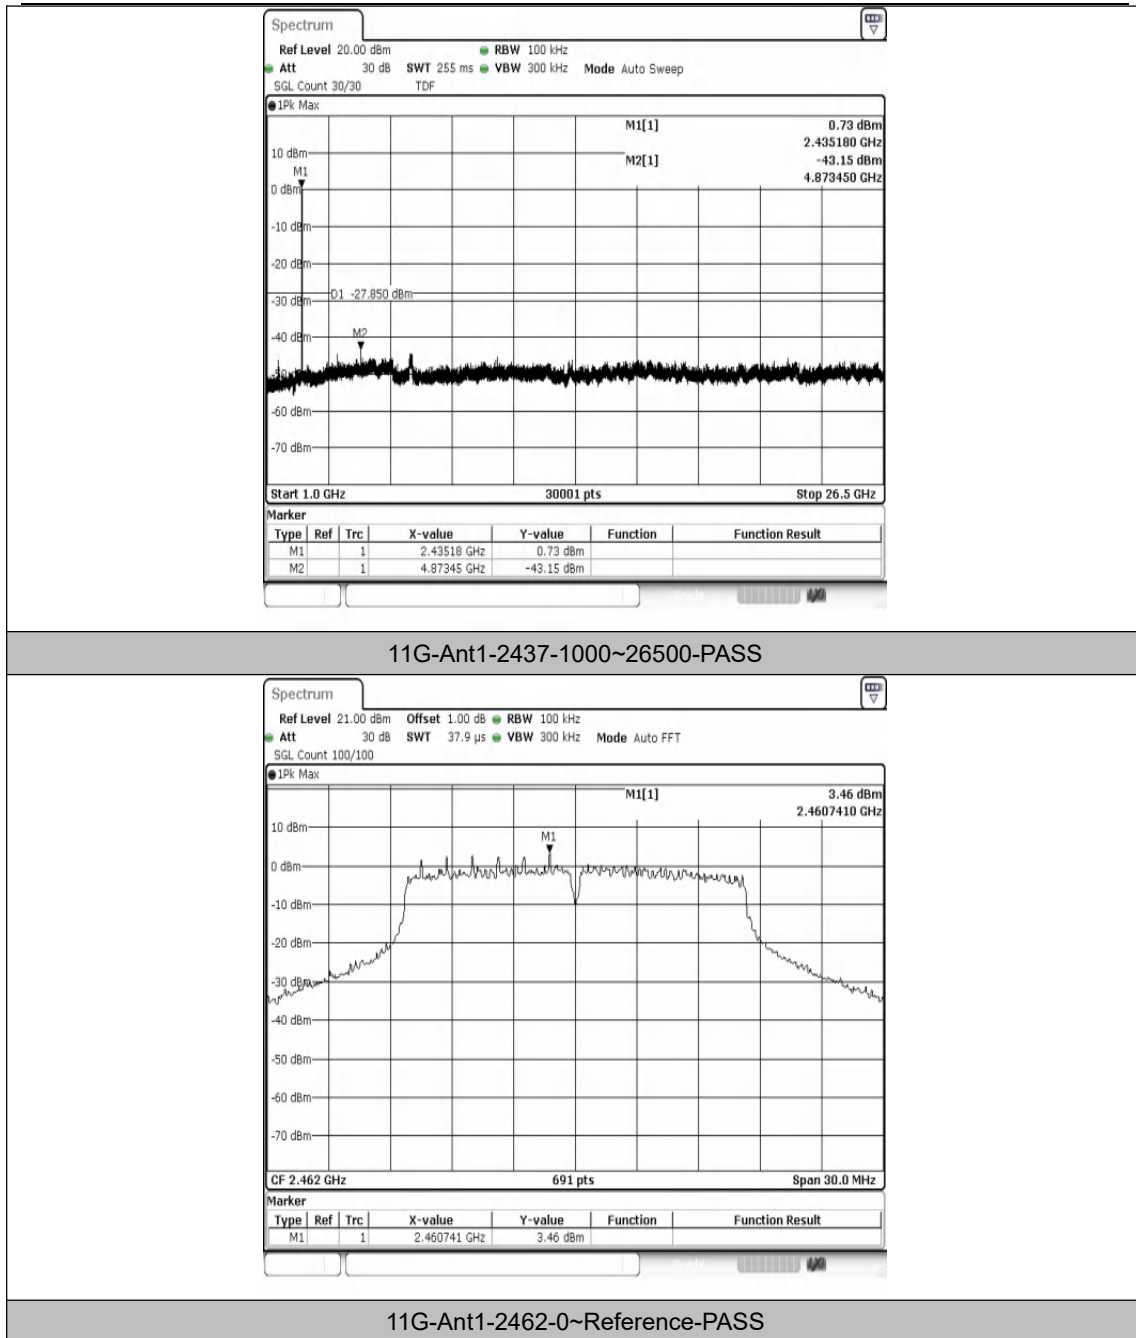

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

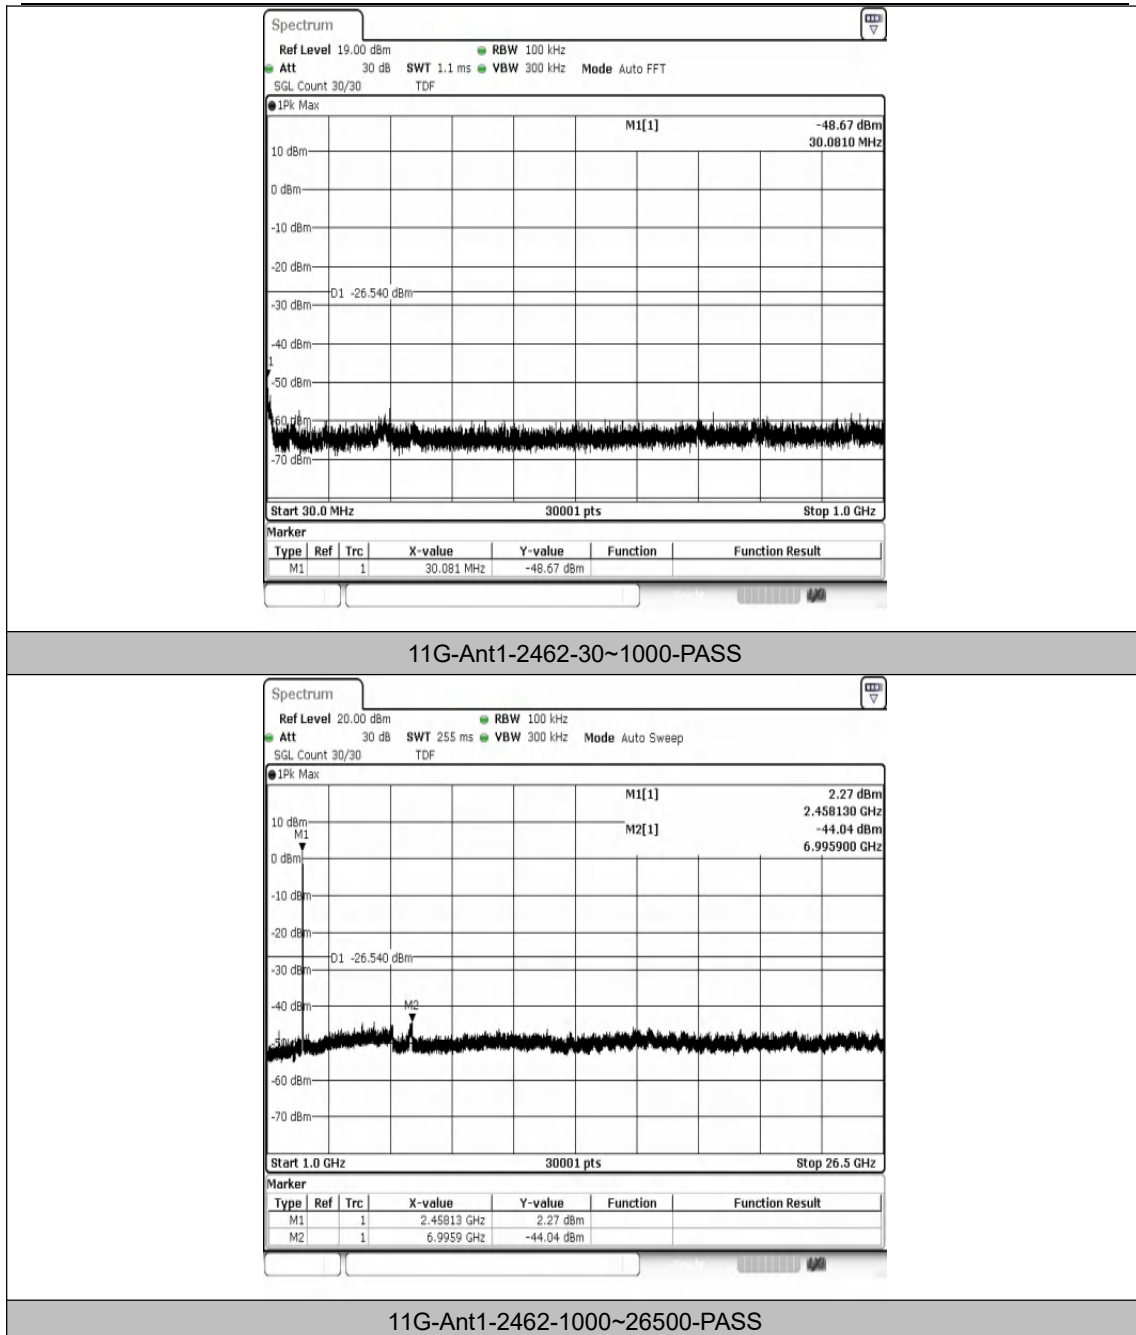

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

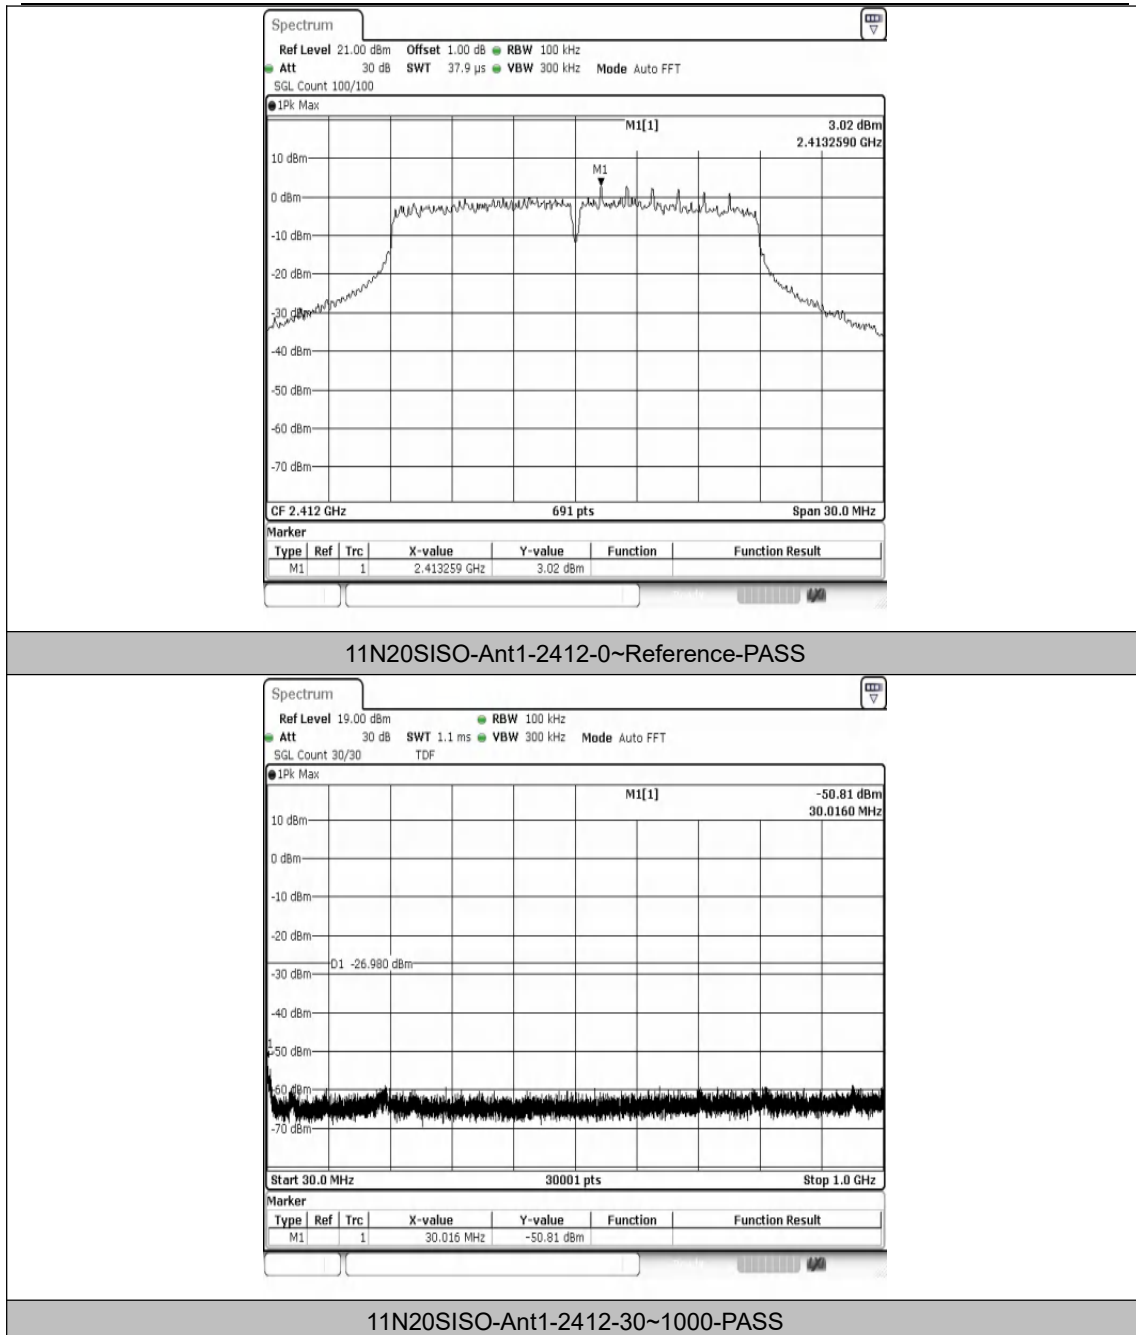

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

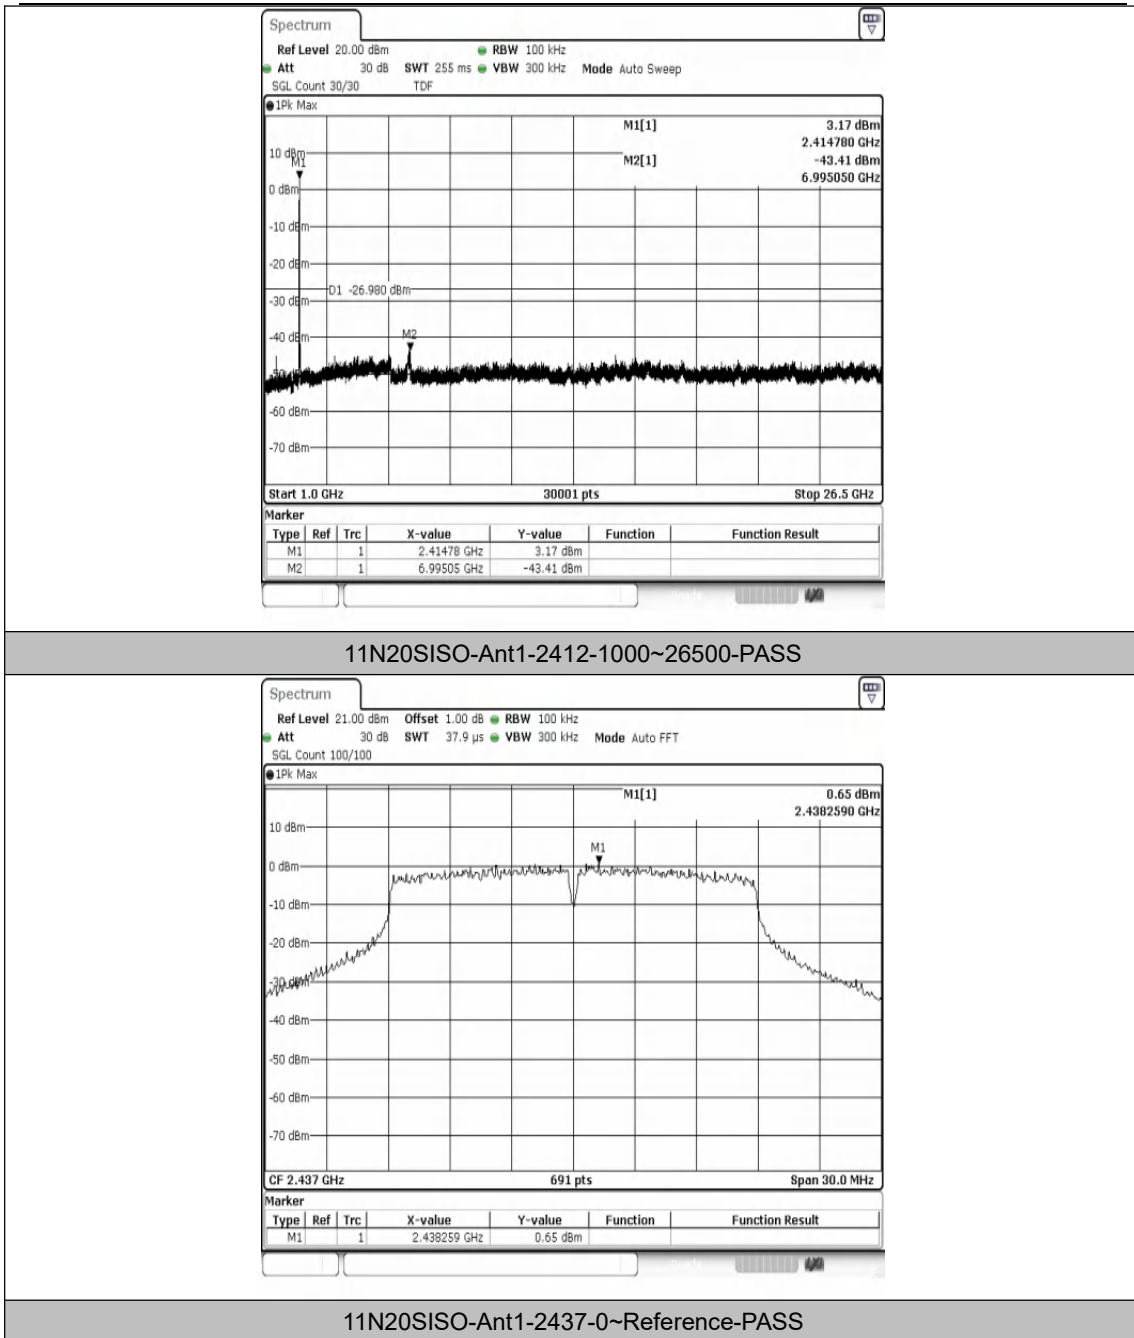

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

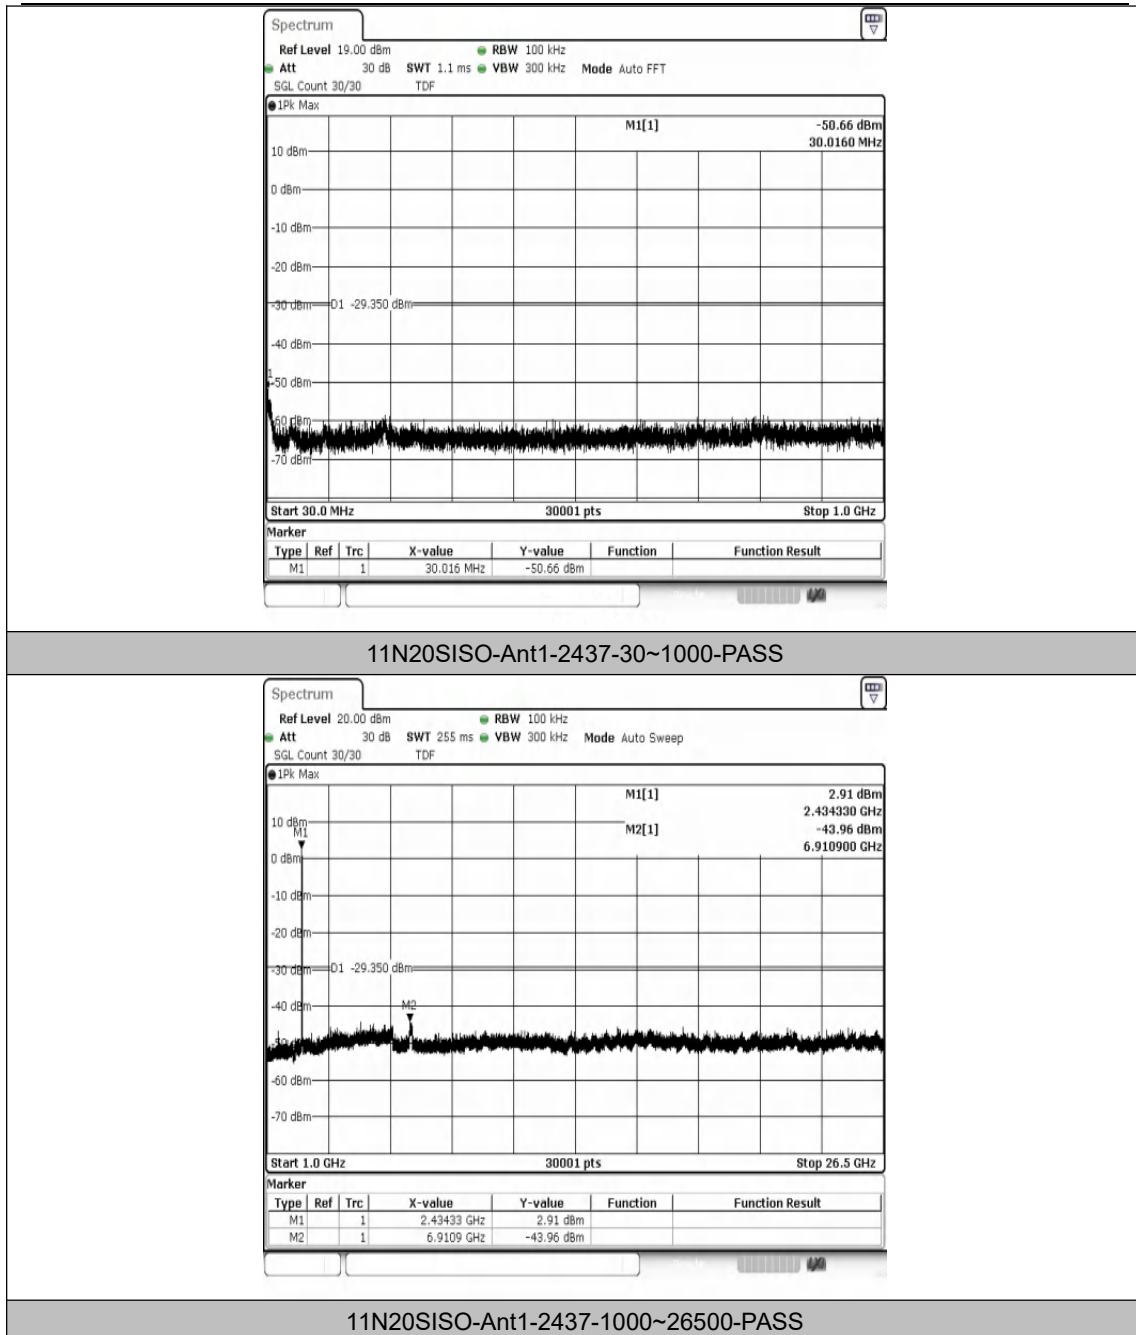

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

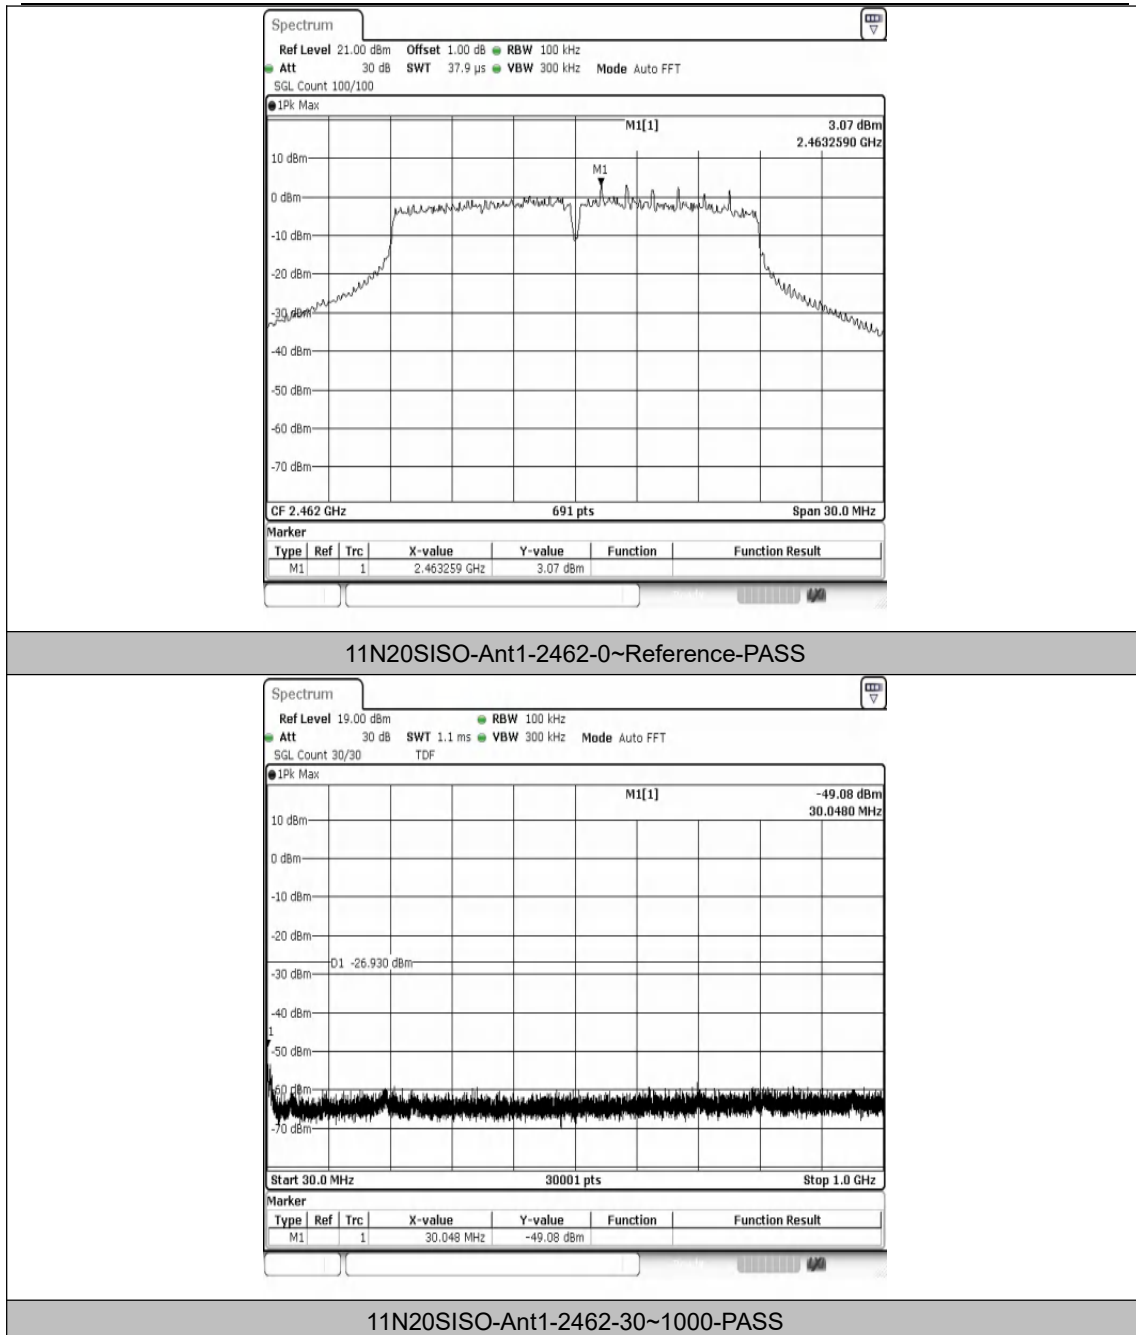

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

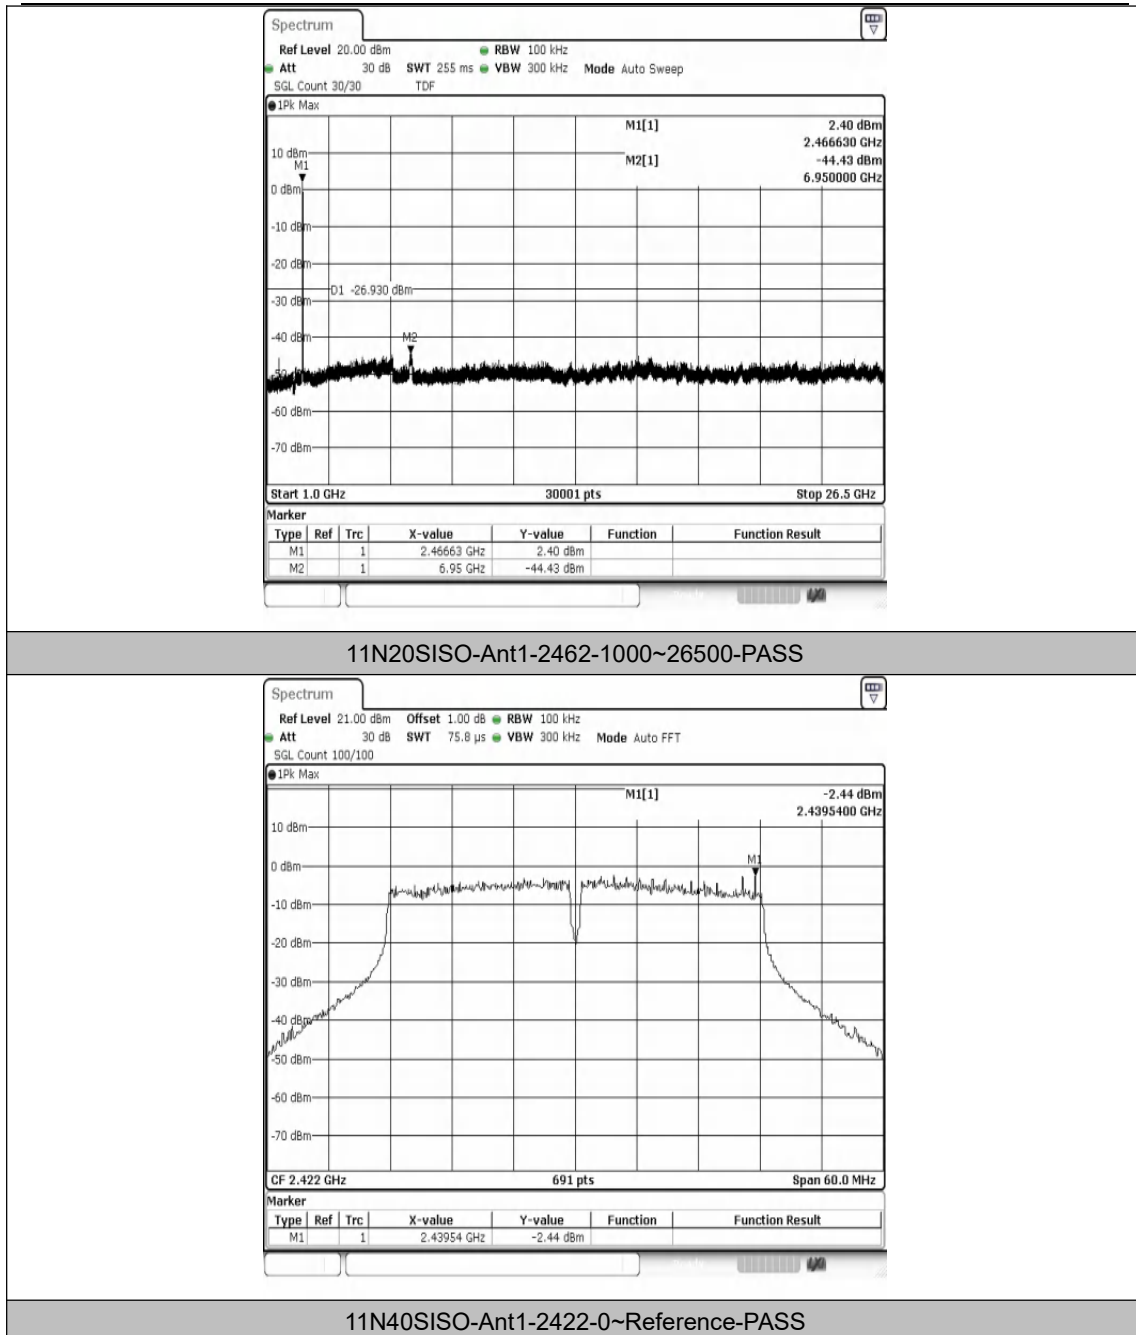

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

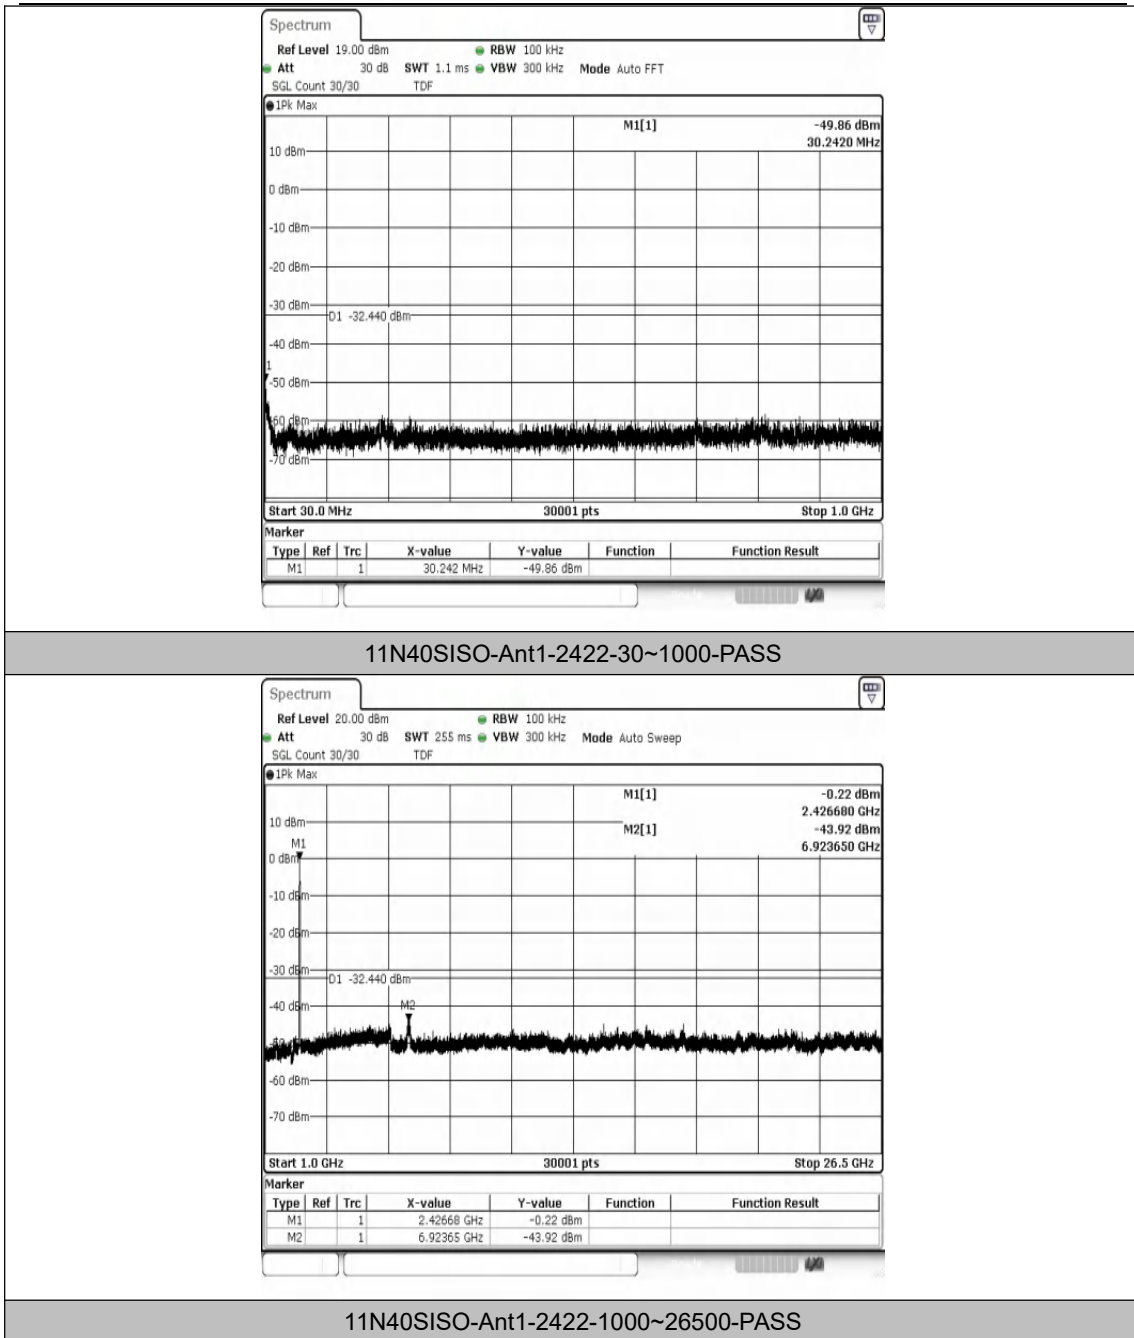


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

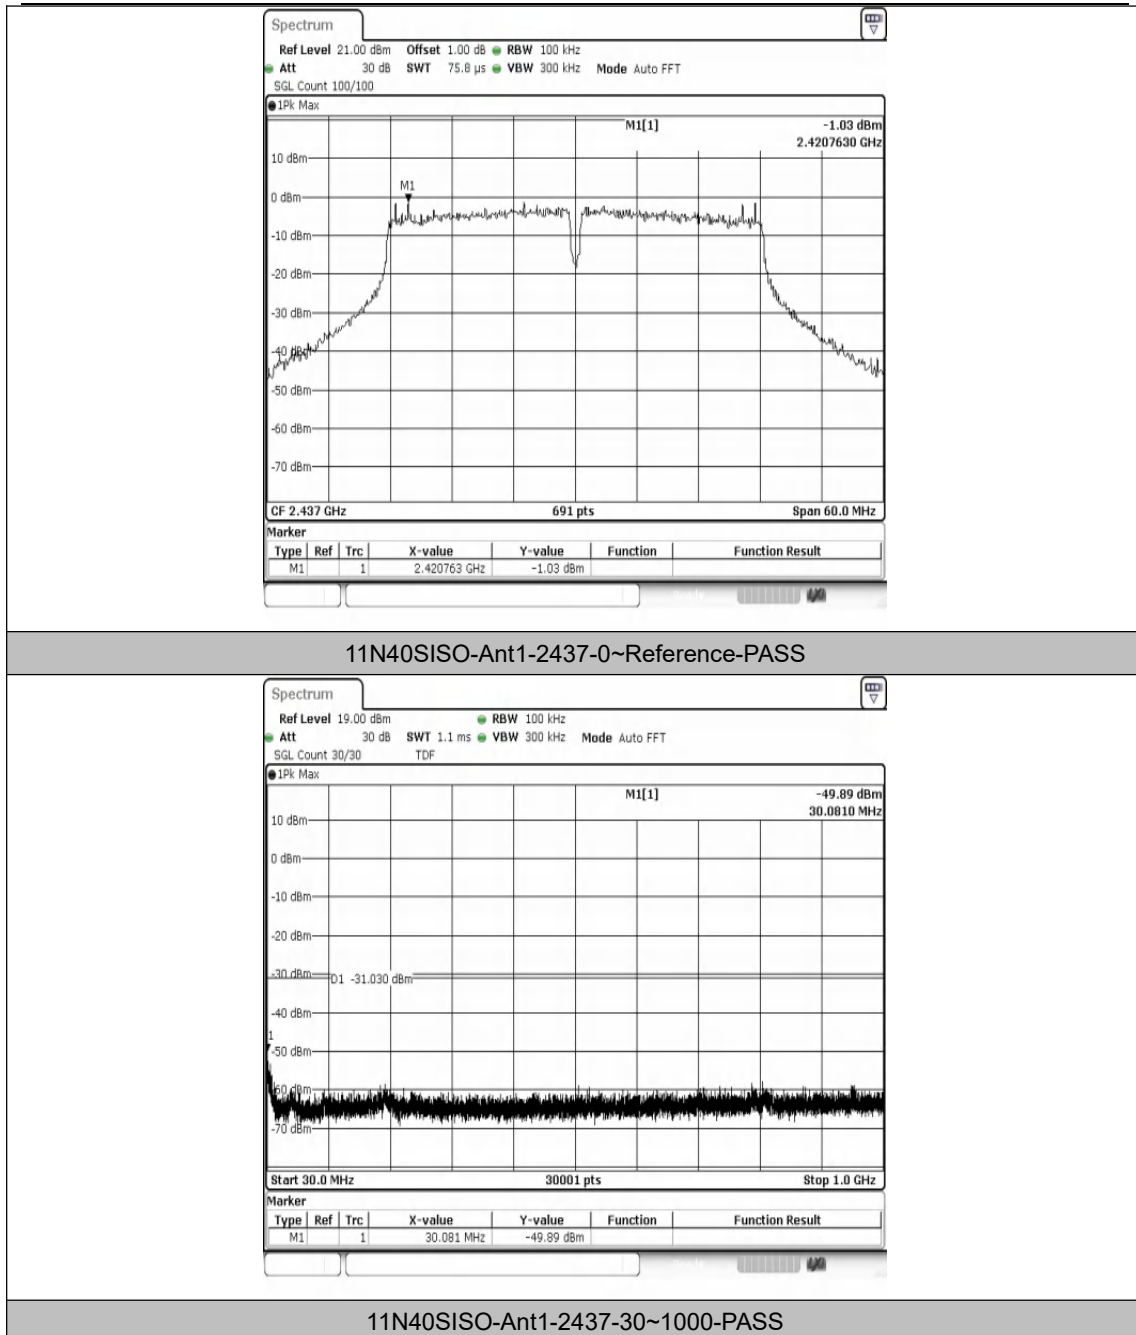


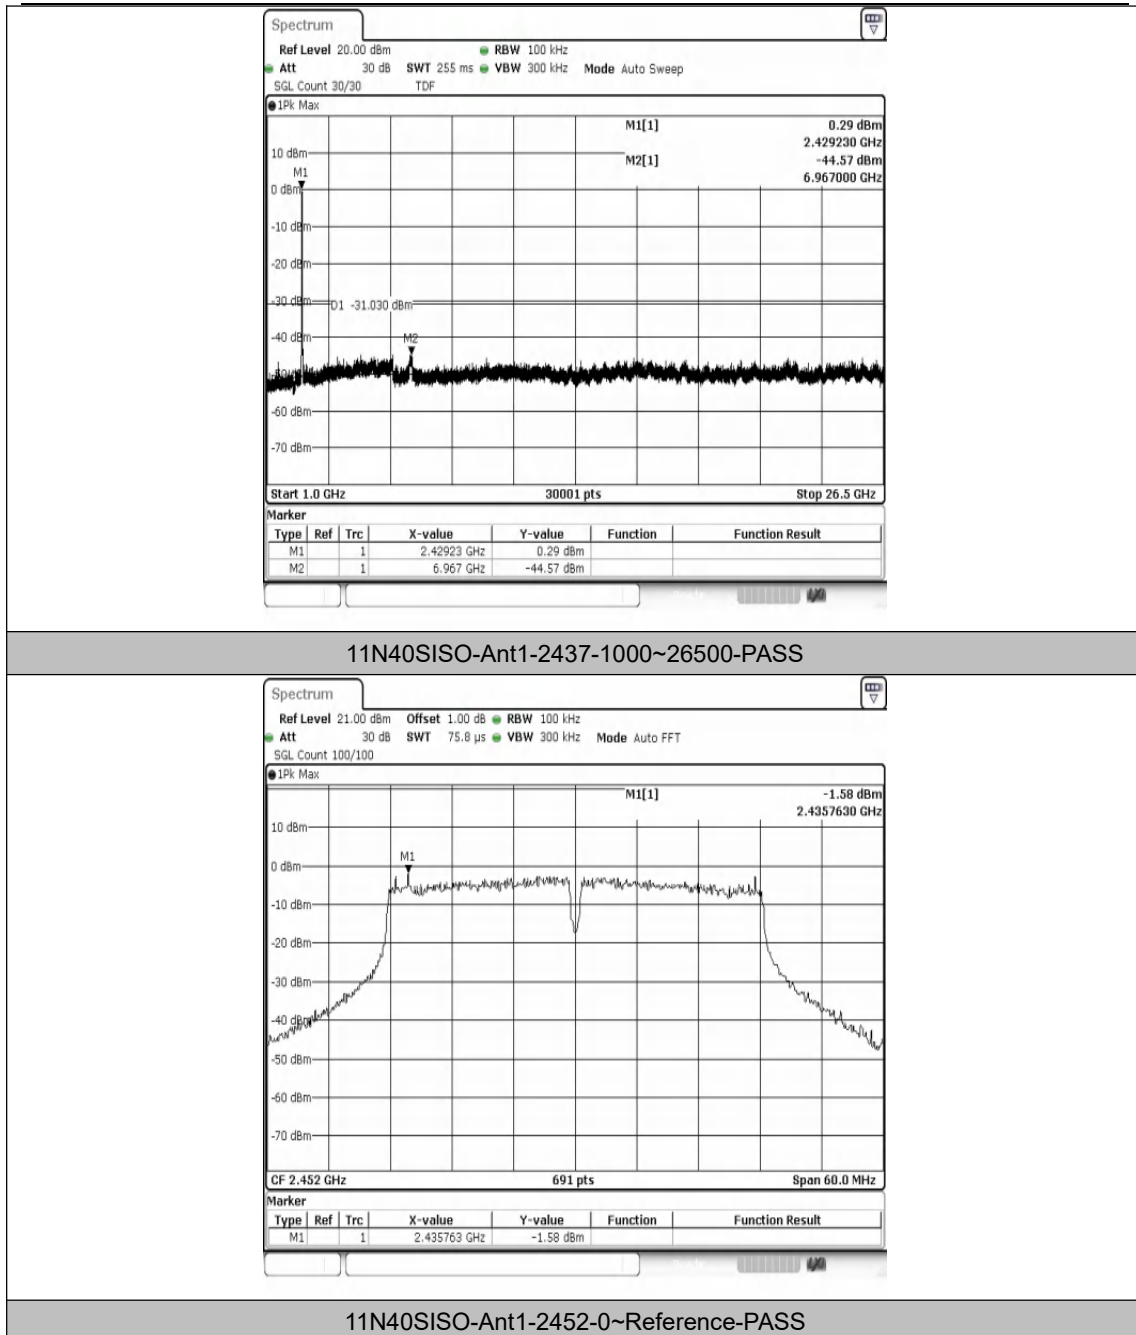

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

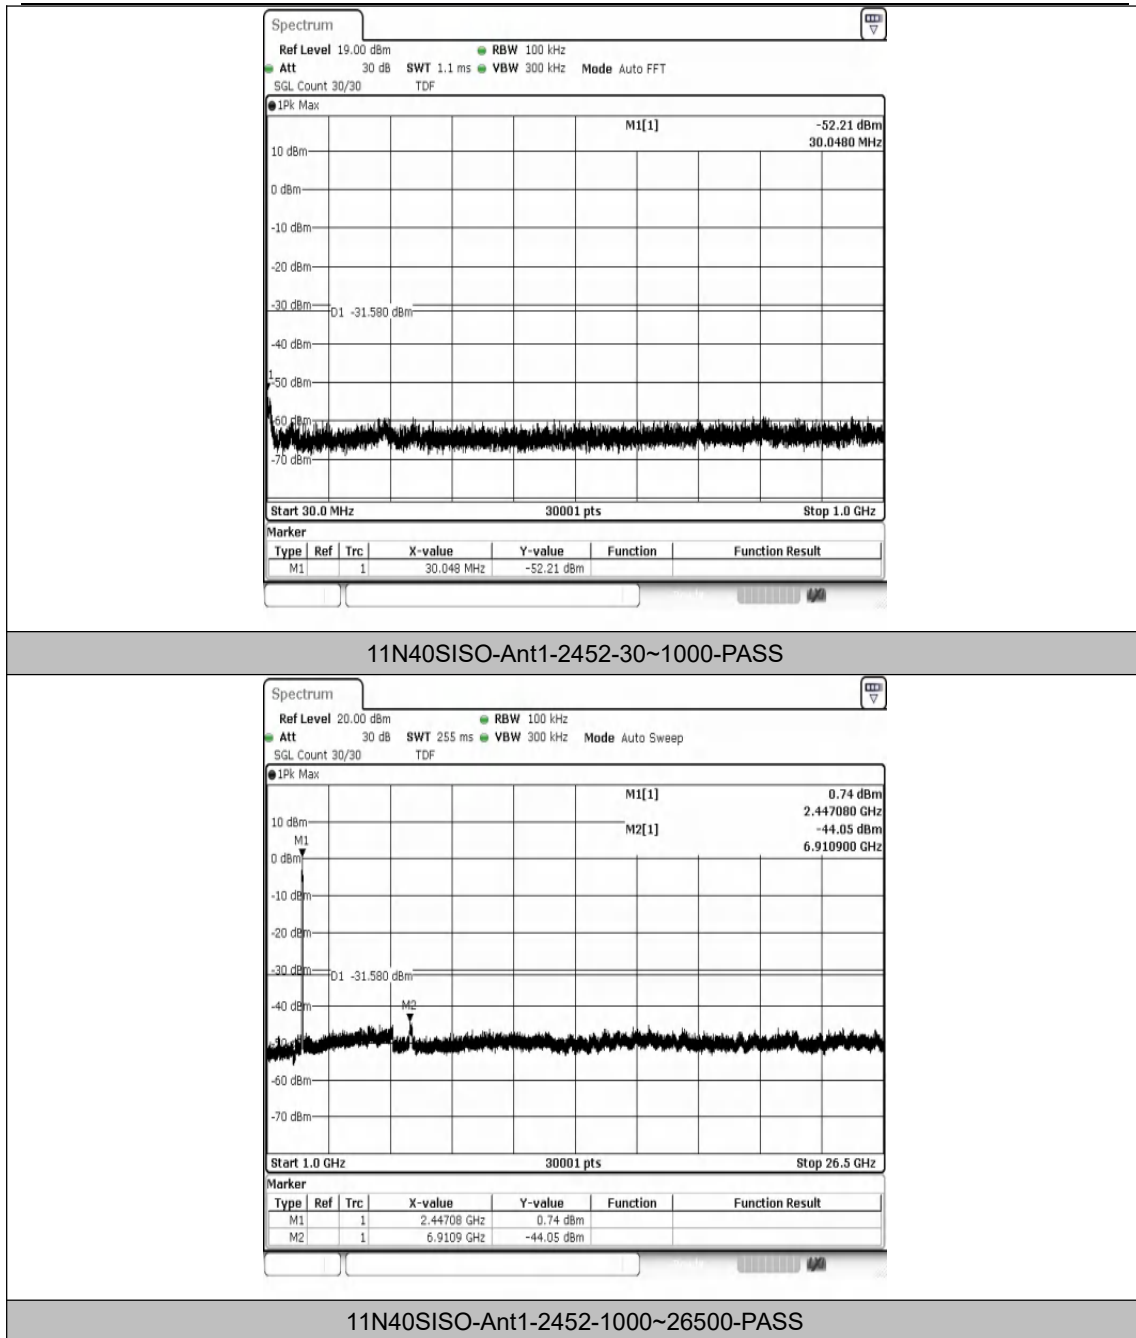


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

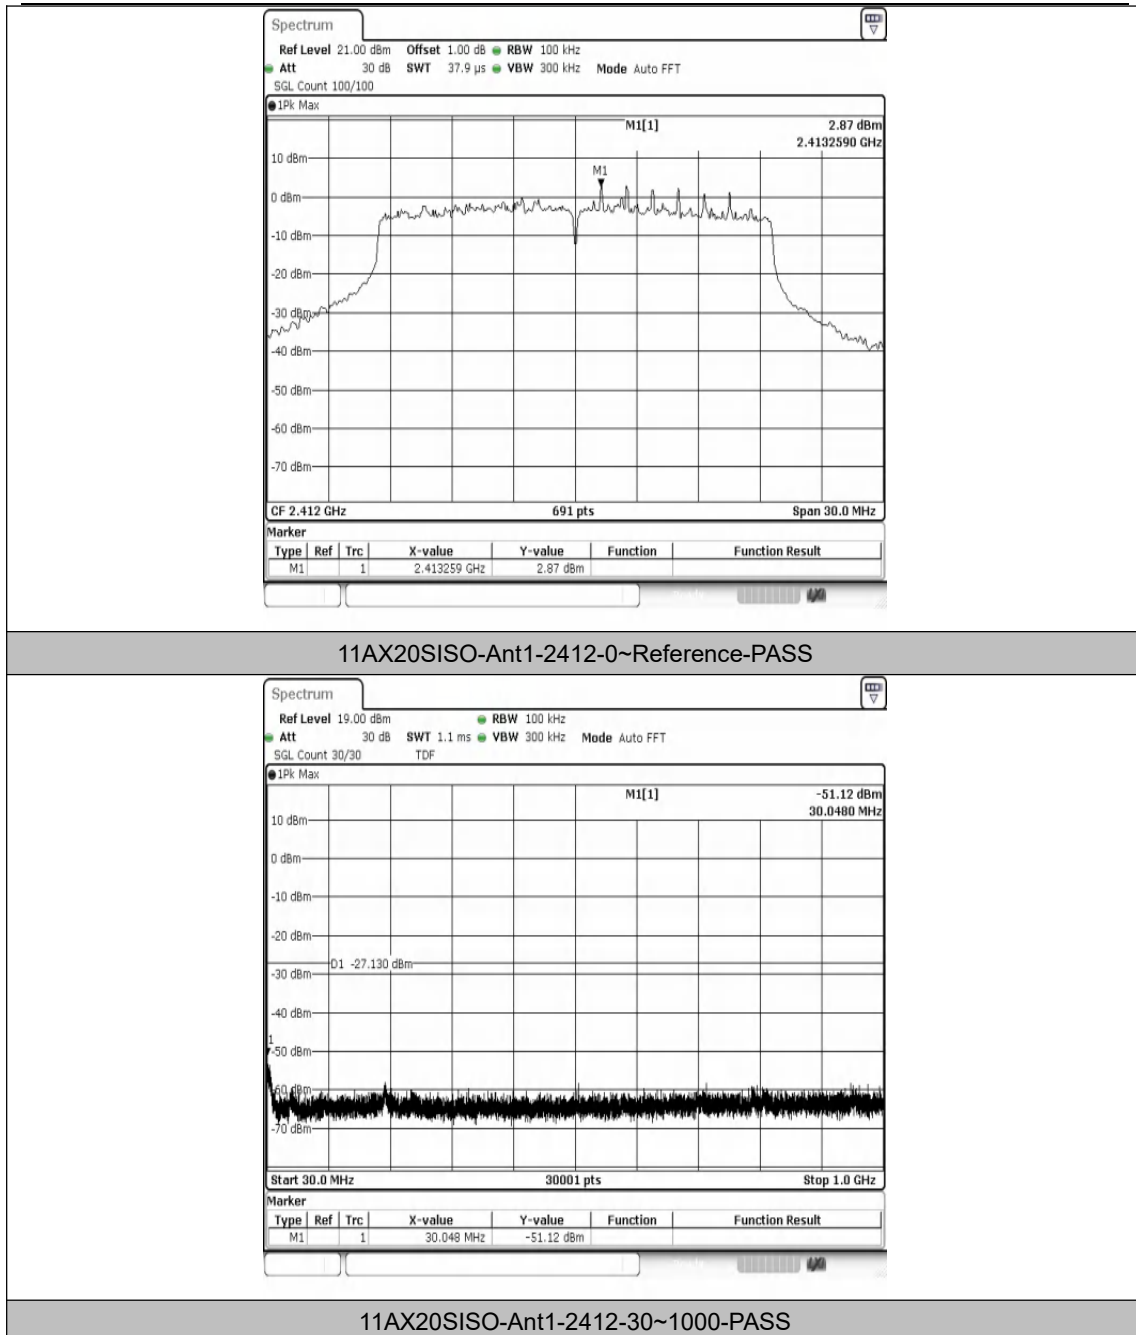


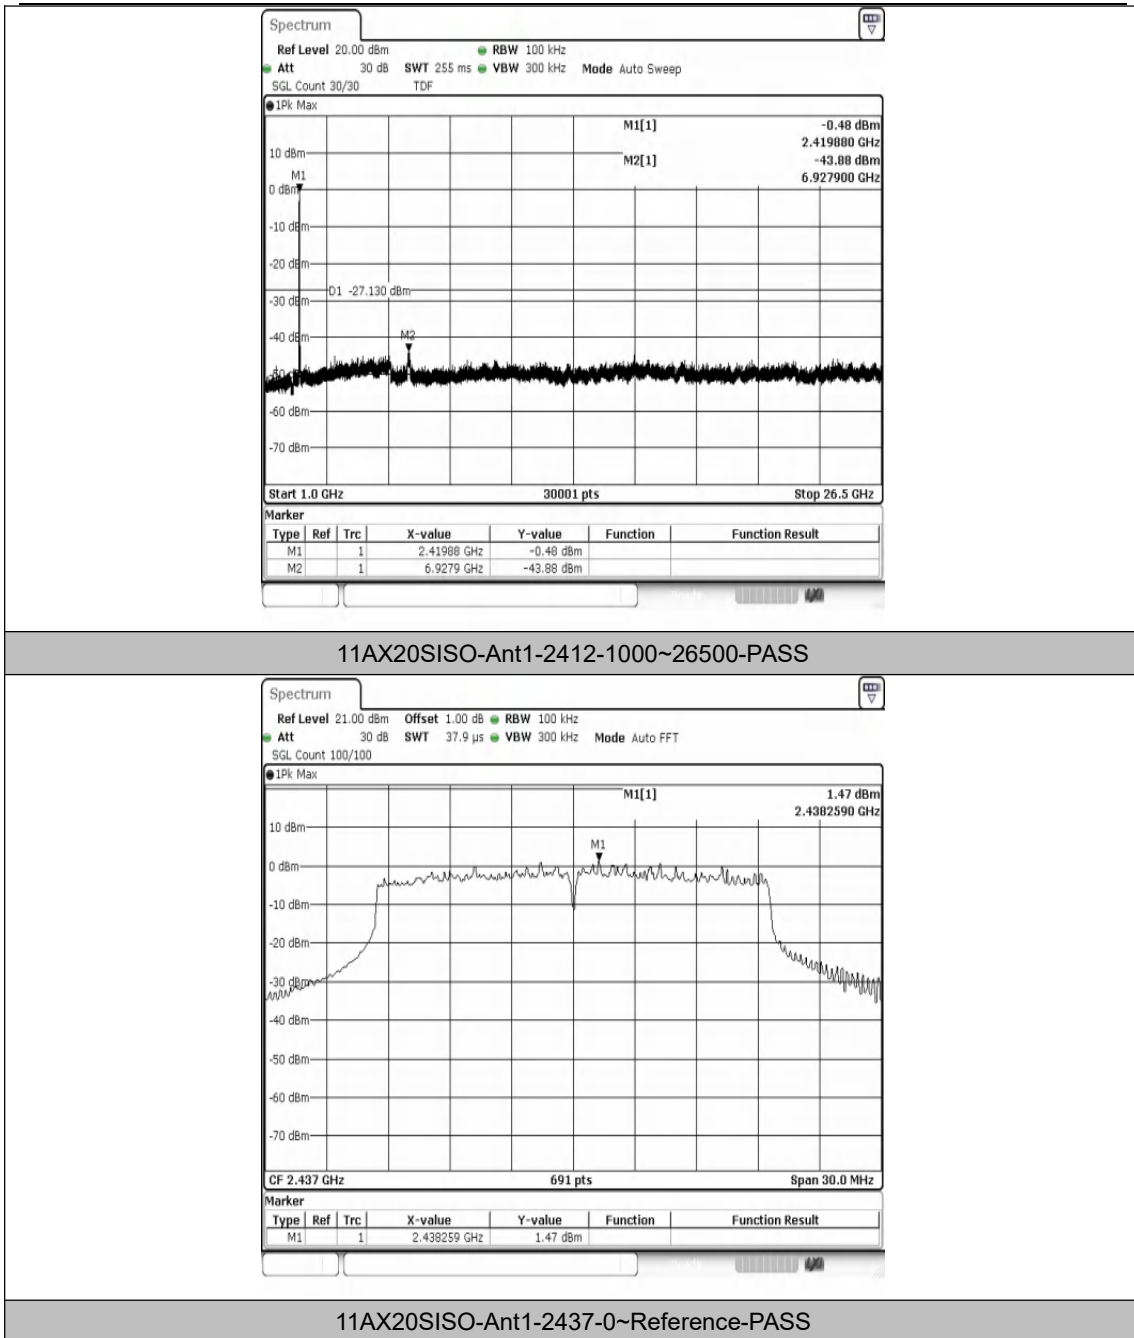



Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

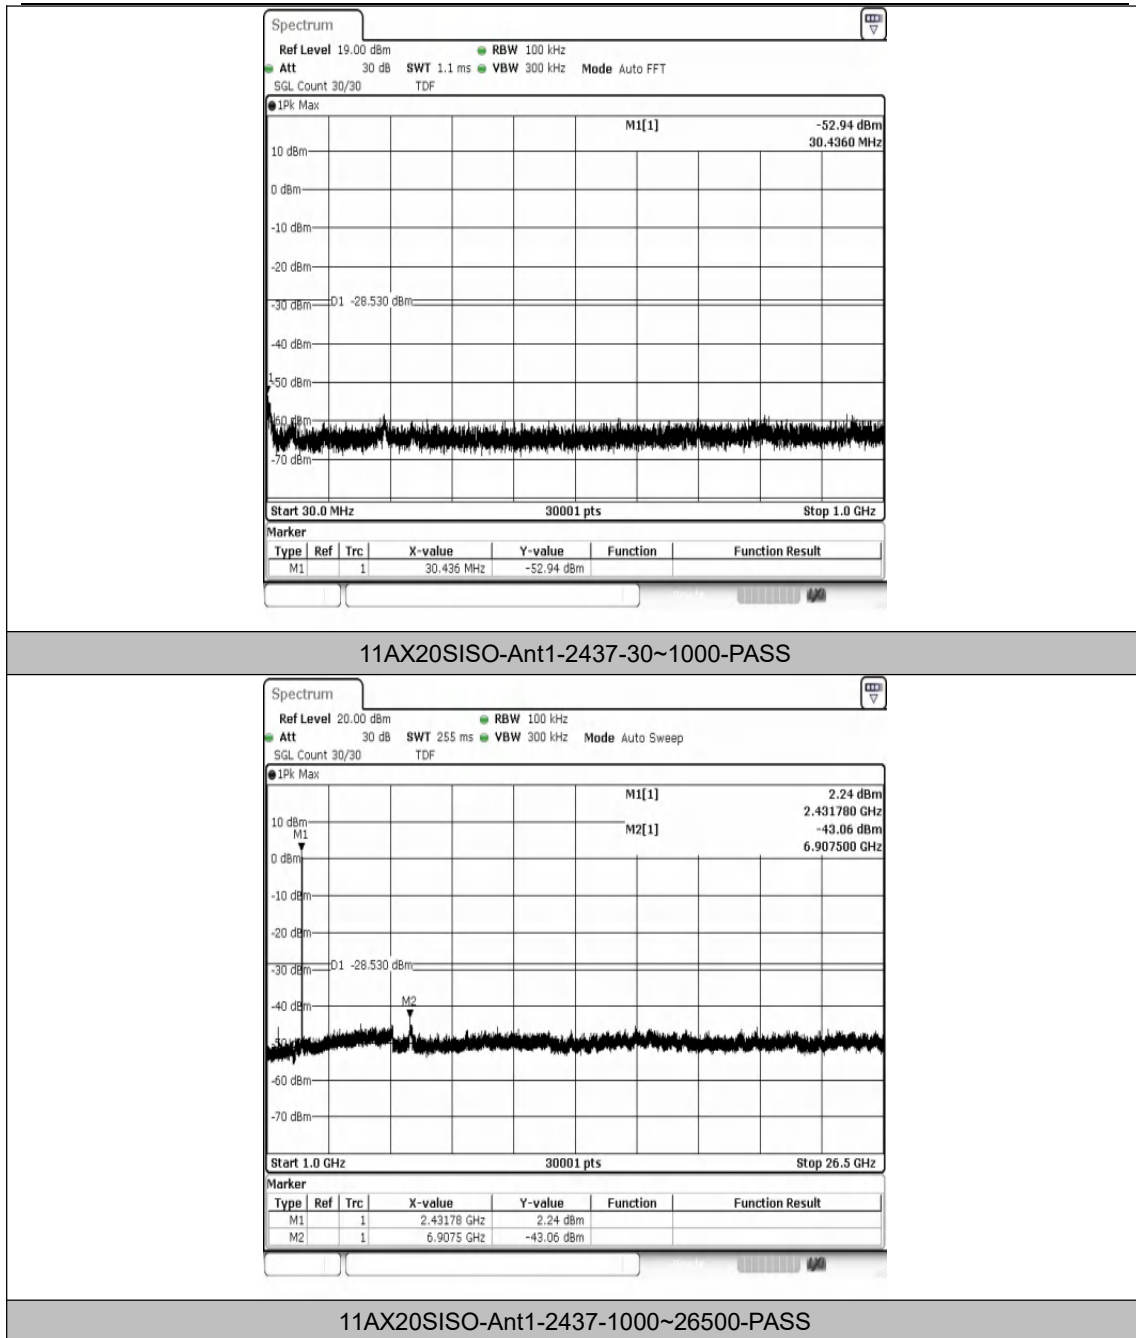

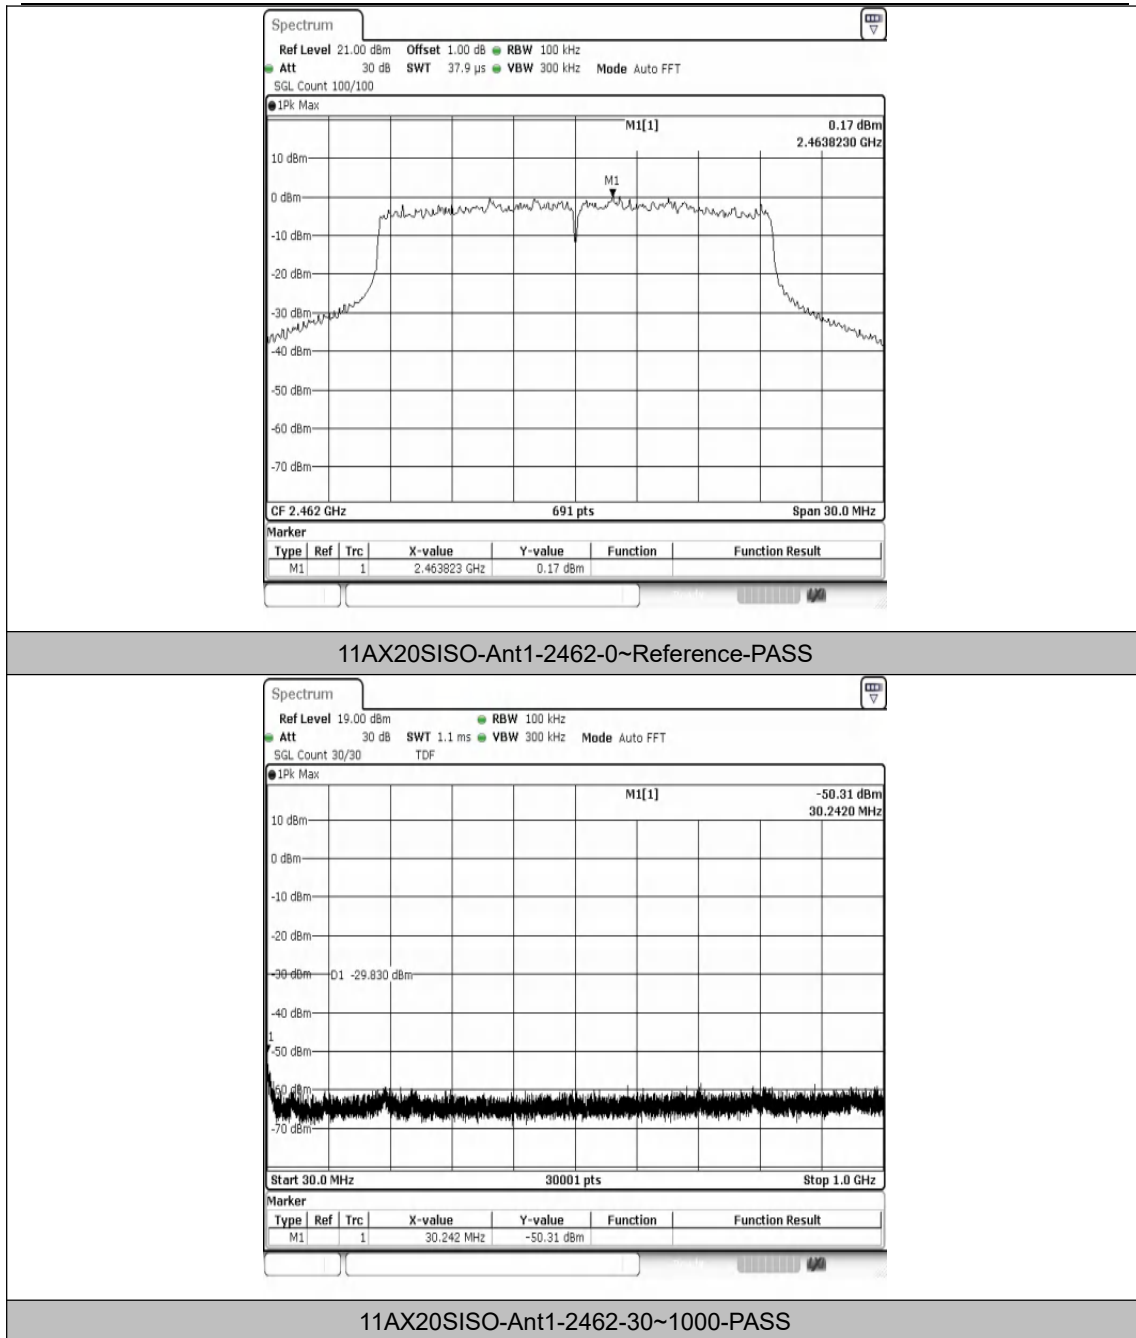

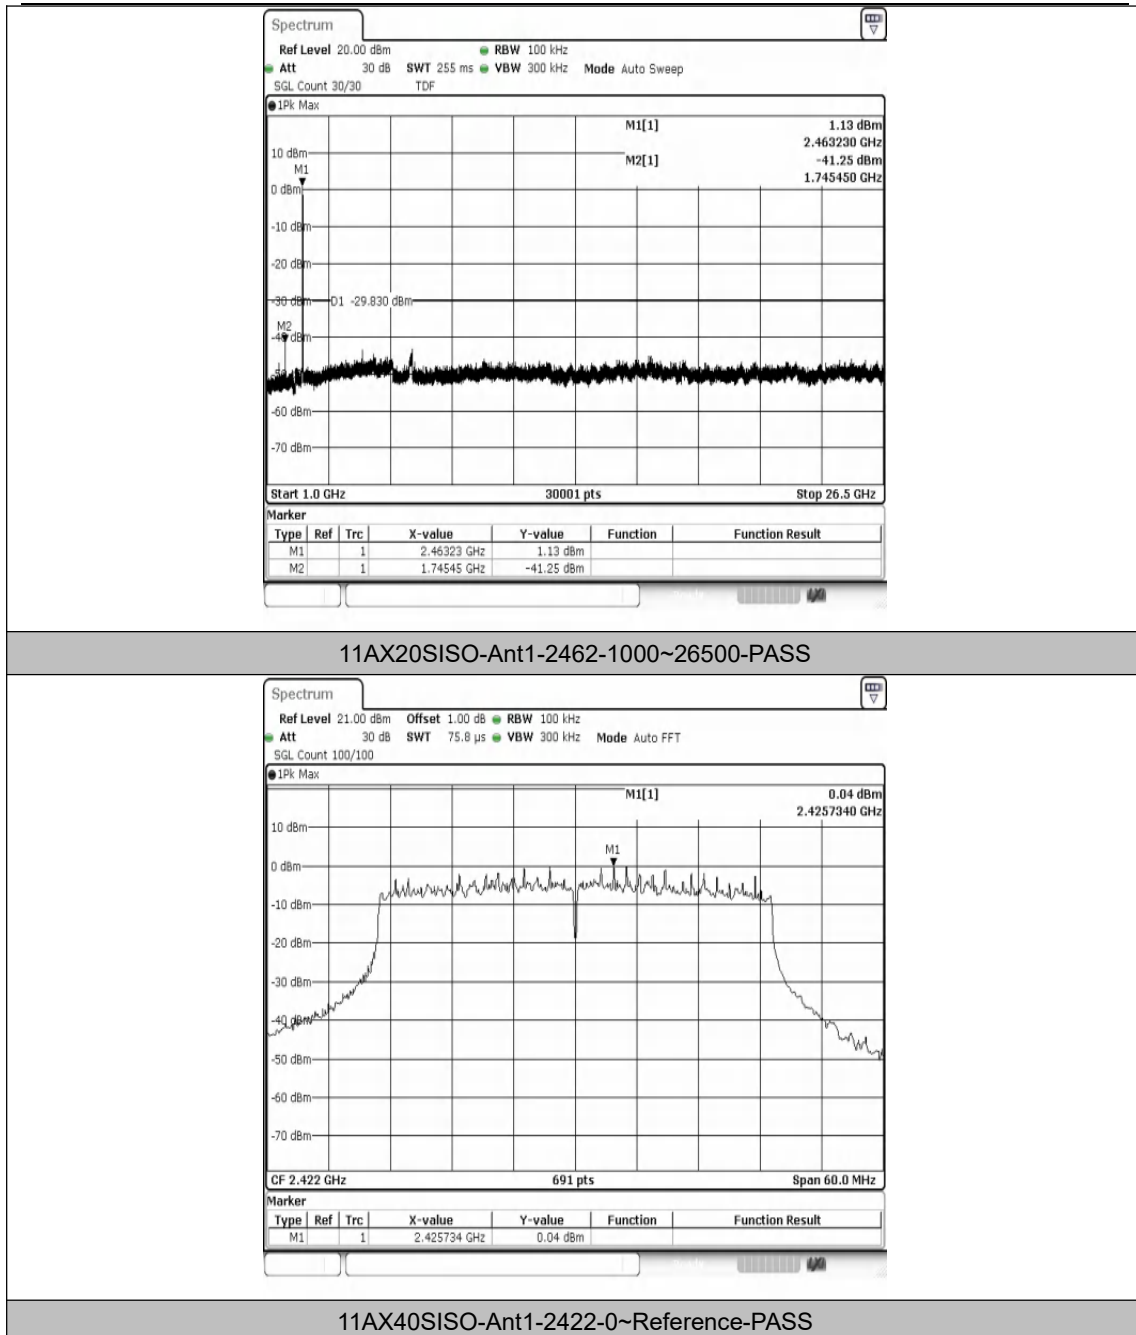

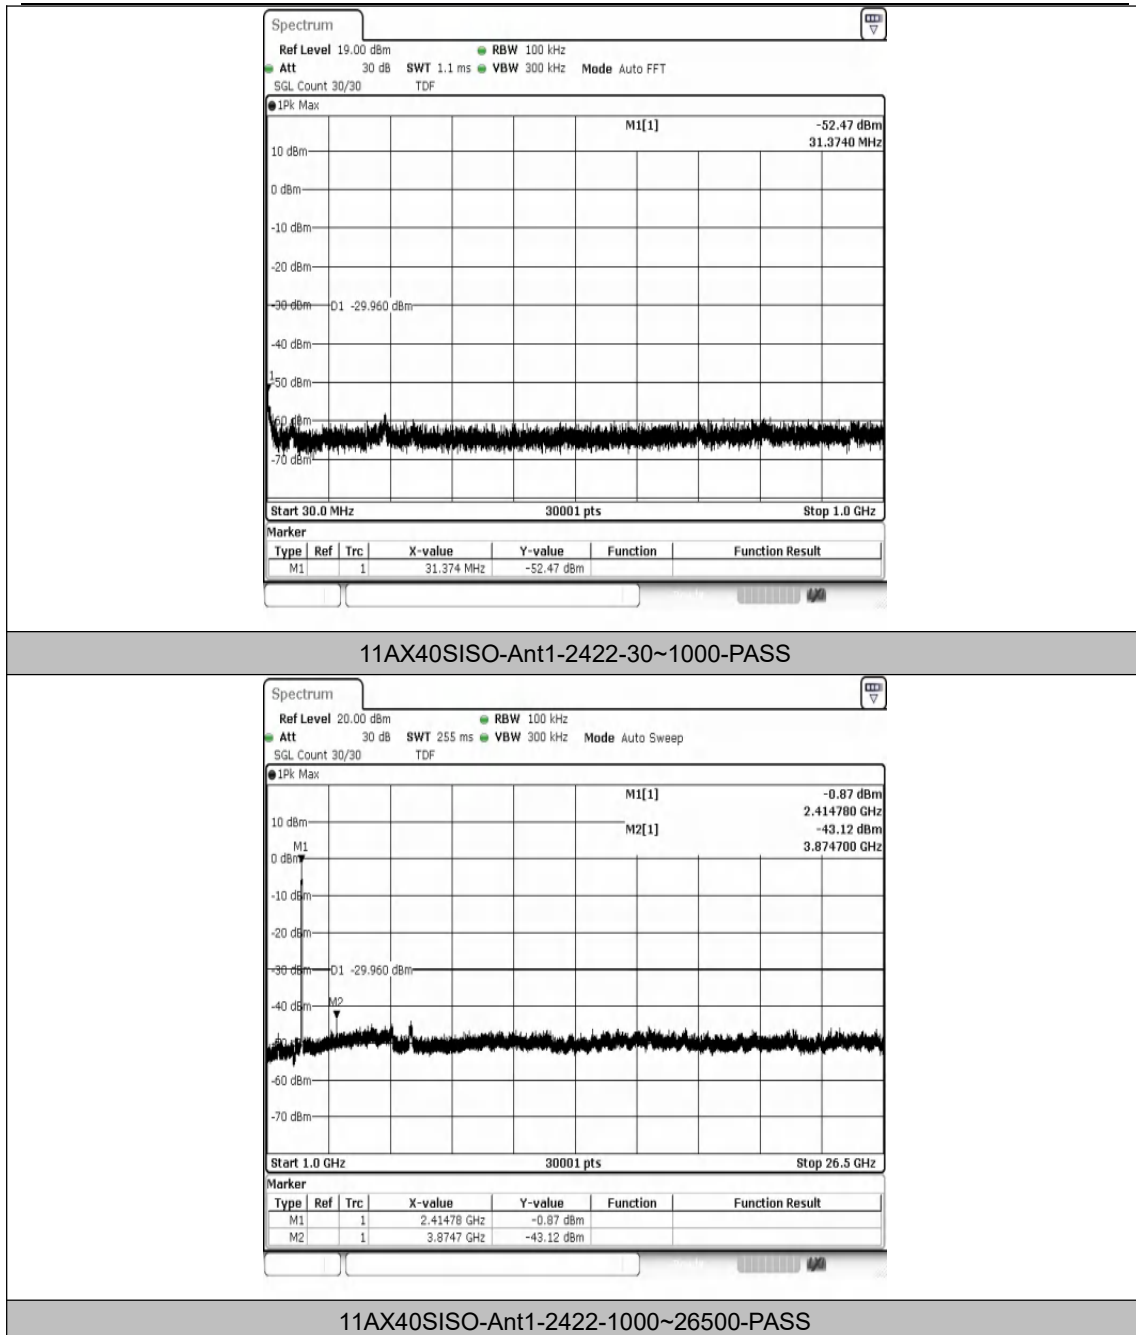


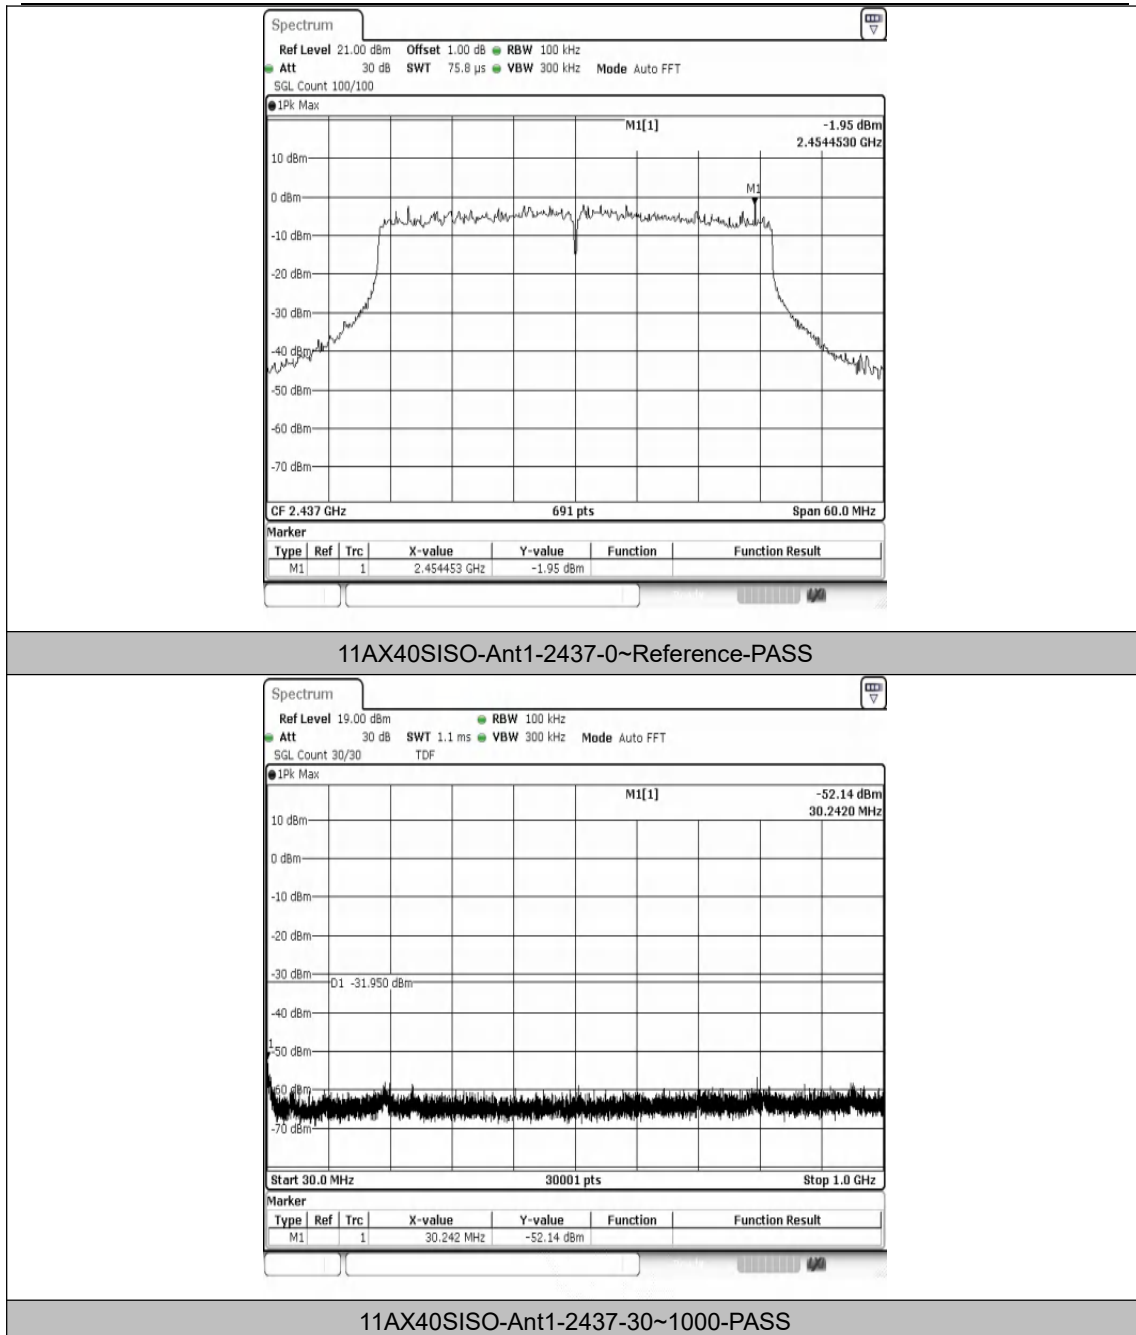


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

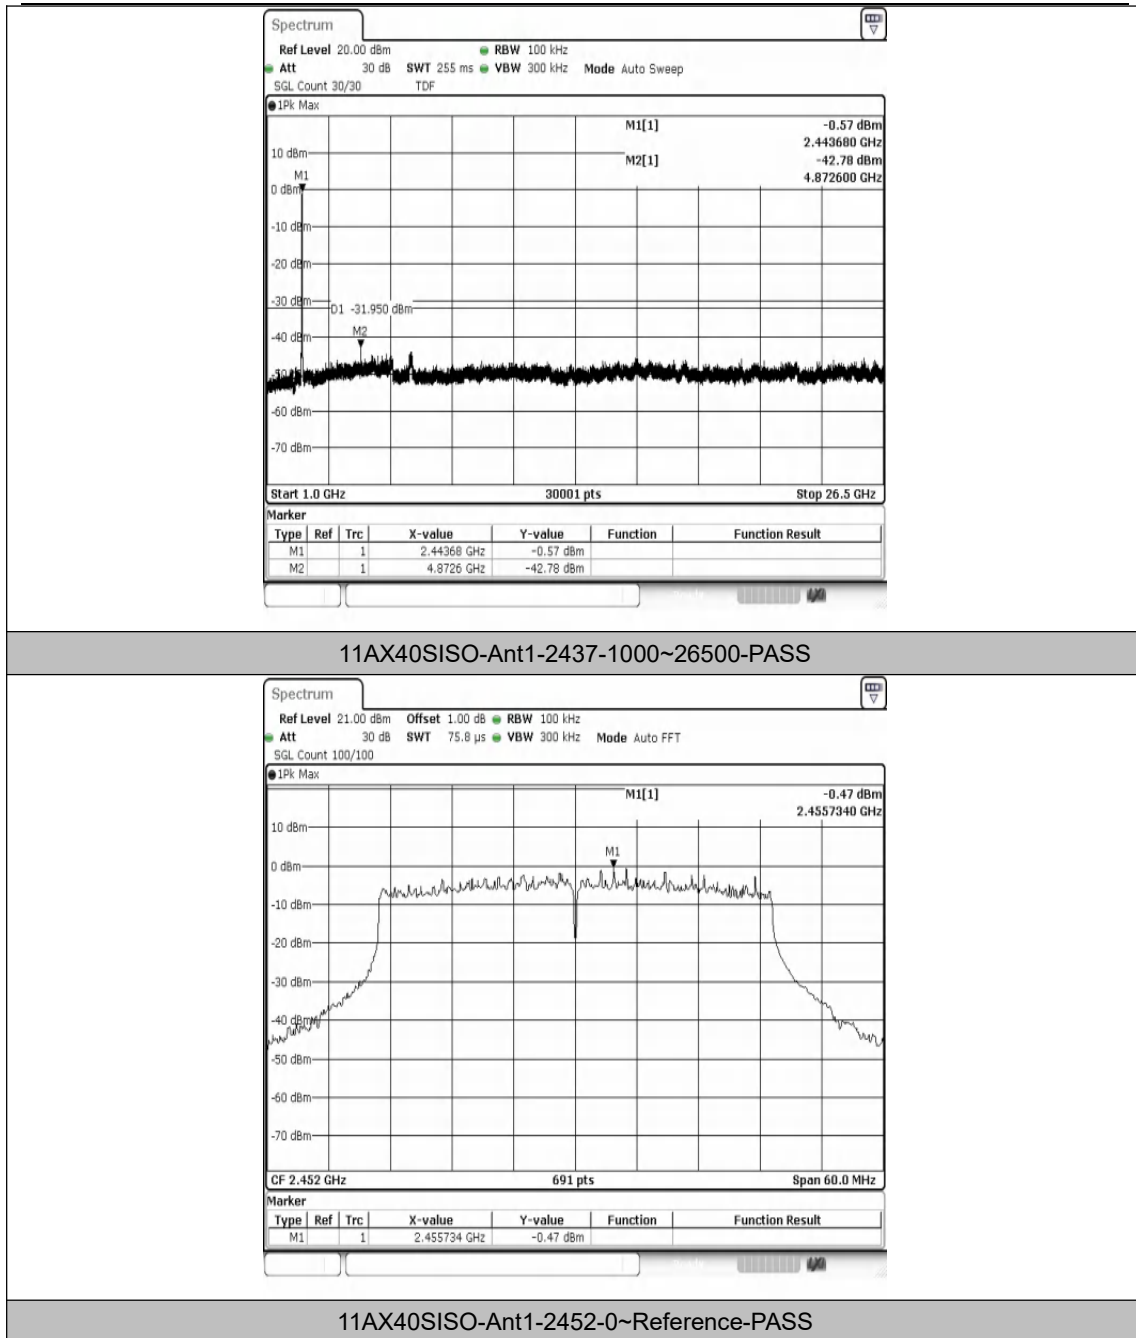

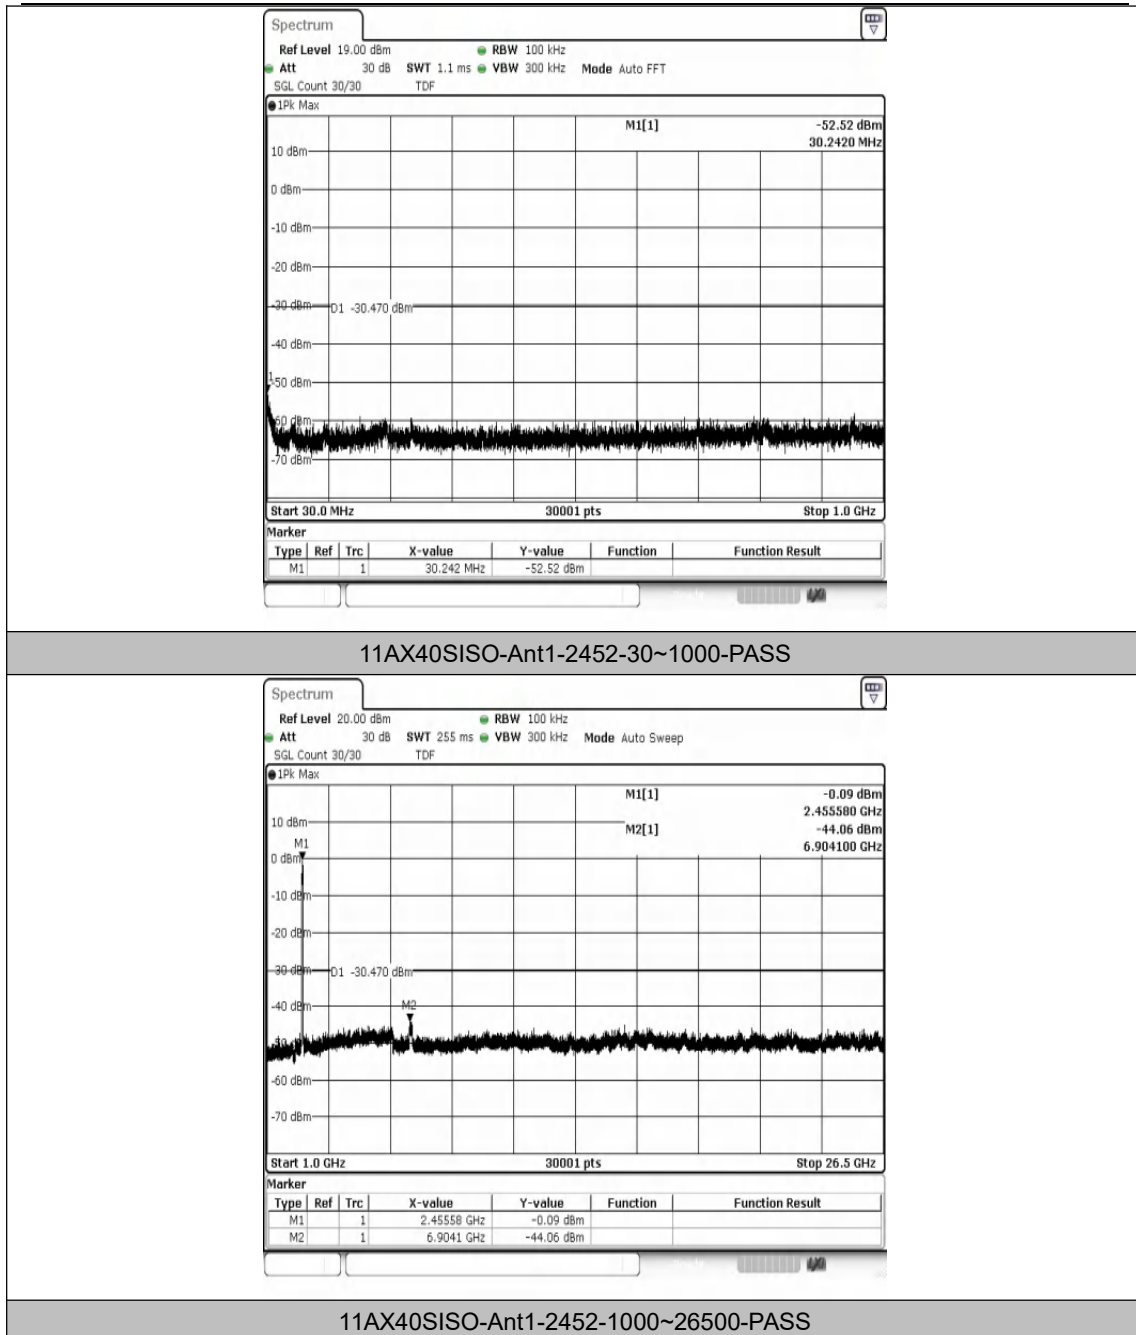


Appendix G: Duty Cycle

Test Result

Test Mode	Antenna	Frequency[MHz]	Transmission Duration [ms]	Transmission Period [ms]	Duty Cycle [%]	Factor [dB]
11B	Ant1	2412	100.00	100.00	100.00	0.00
11B	Ant1	2437	100.00	100.00	100.00	0.00
11B	Ant1	2462	100.00	100.00	100.00	0.00
11G	Ant1	2412	100.00	100.00	100.00	0.00
11G	Ant1	2437	100.00	100.00	100.00	0.00
11G	Ant1	2462	100.00	100.00	100.00	0.00
11N20SISO	Ant1	2412	100.00	100.00	100.00	0.00
11N20SISO	Ant1	2437	100.00	100.00	100.00	0.00
11N20SISO	Ant1	2462	100.00	100.00	100.00	0.00
11N40SISO	Ant1	2422	100.00	100.00	100.00	0.00
11N40SISO	Ant1	2437	100.00	100.00	100.00	0.00
11N40SISO	Ant1	2452	100.00	100.00	100.00	0.00
11AX20SISO	Ant1	2412	100.00	100.00	100.00	0.00
11AX20SISO	Ant1	2437	100.00	100.00	100.00	0.00
11AX20SISO	Ant1	2462	100.00	100.00	100.00	0.00
11AX40SISO	Ant1	2422	100.00	100.00	100.00	0.00
11AX40SISO	Ant1	2437	100.00	100.00	100.00	0.00
11AX40SISO	Ant1	2452	100.00	100.00	100.00	0.00


Test Graphs

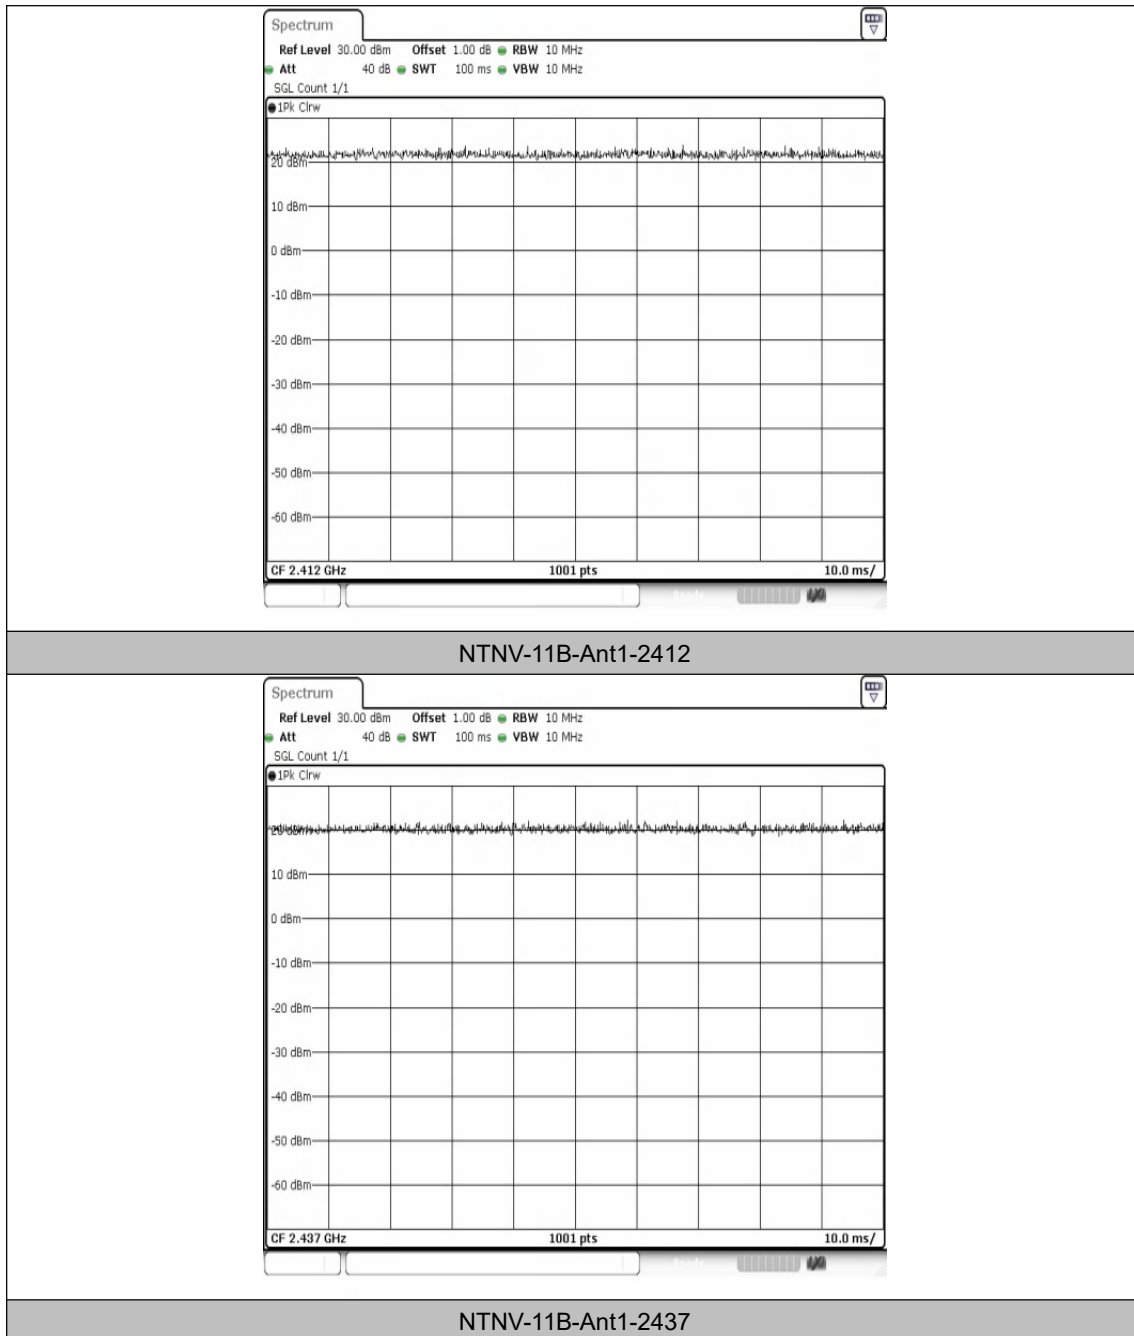

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

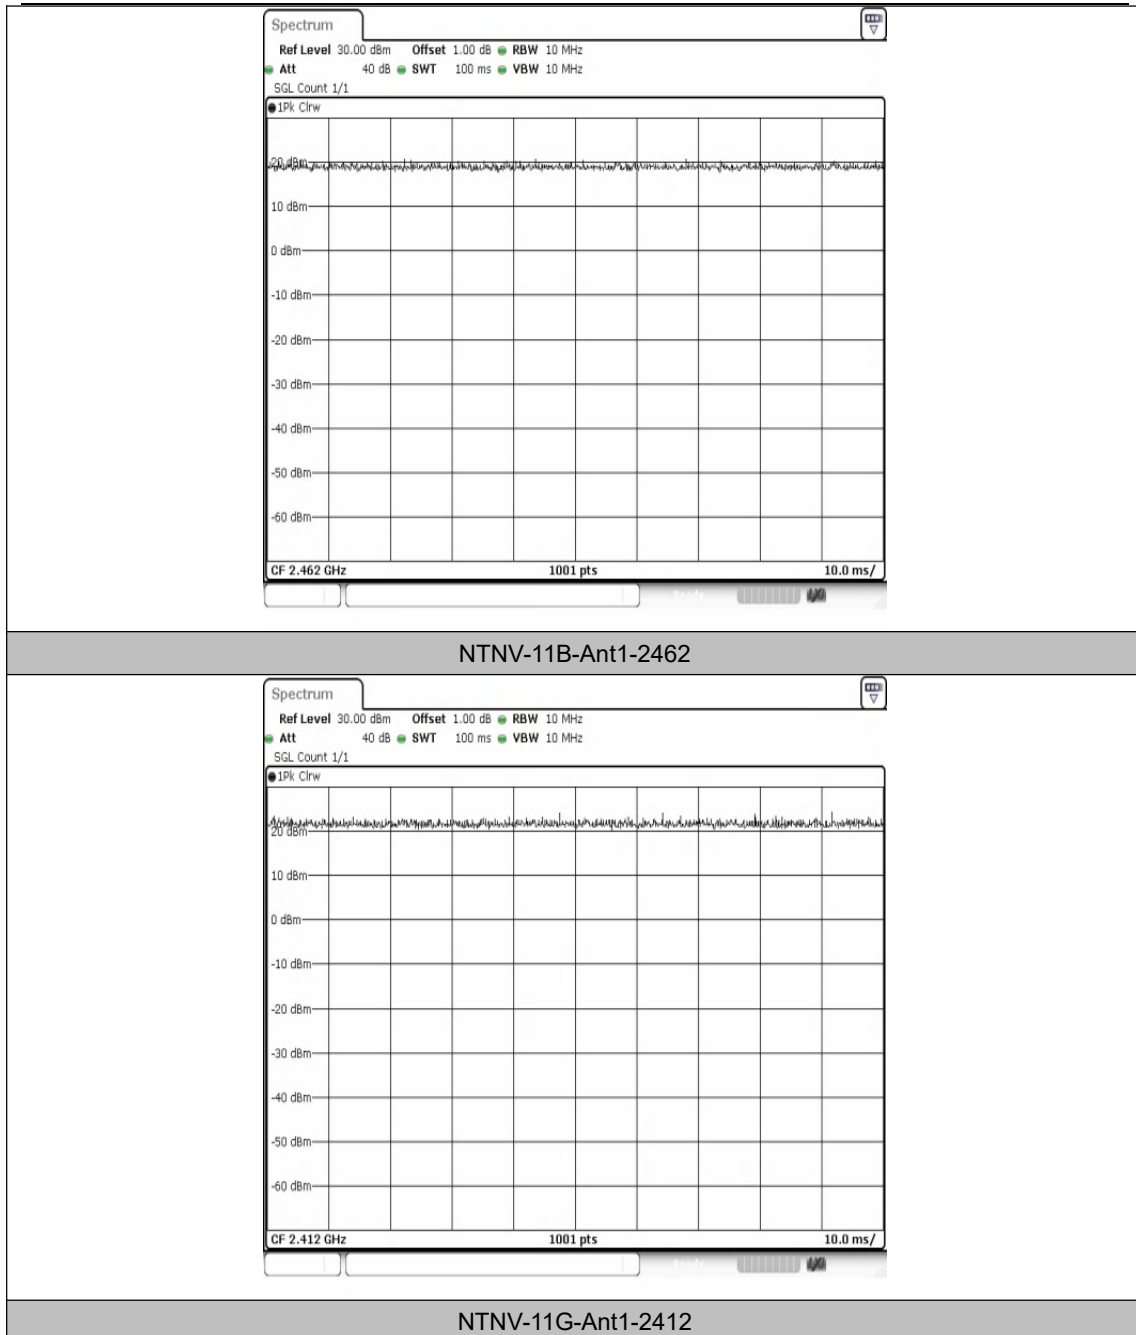

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

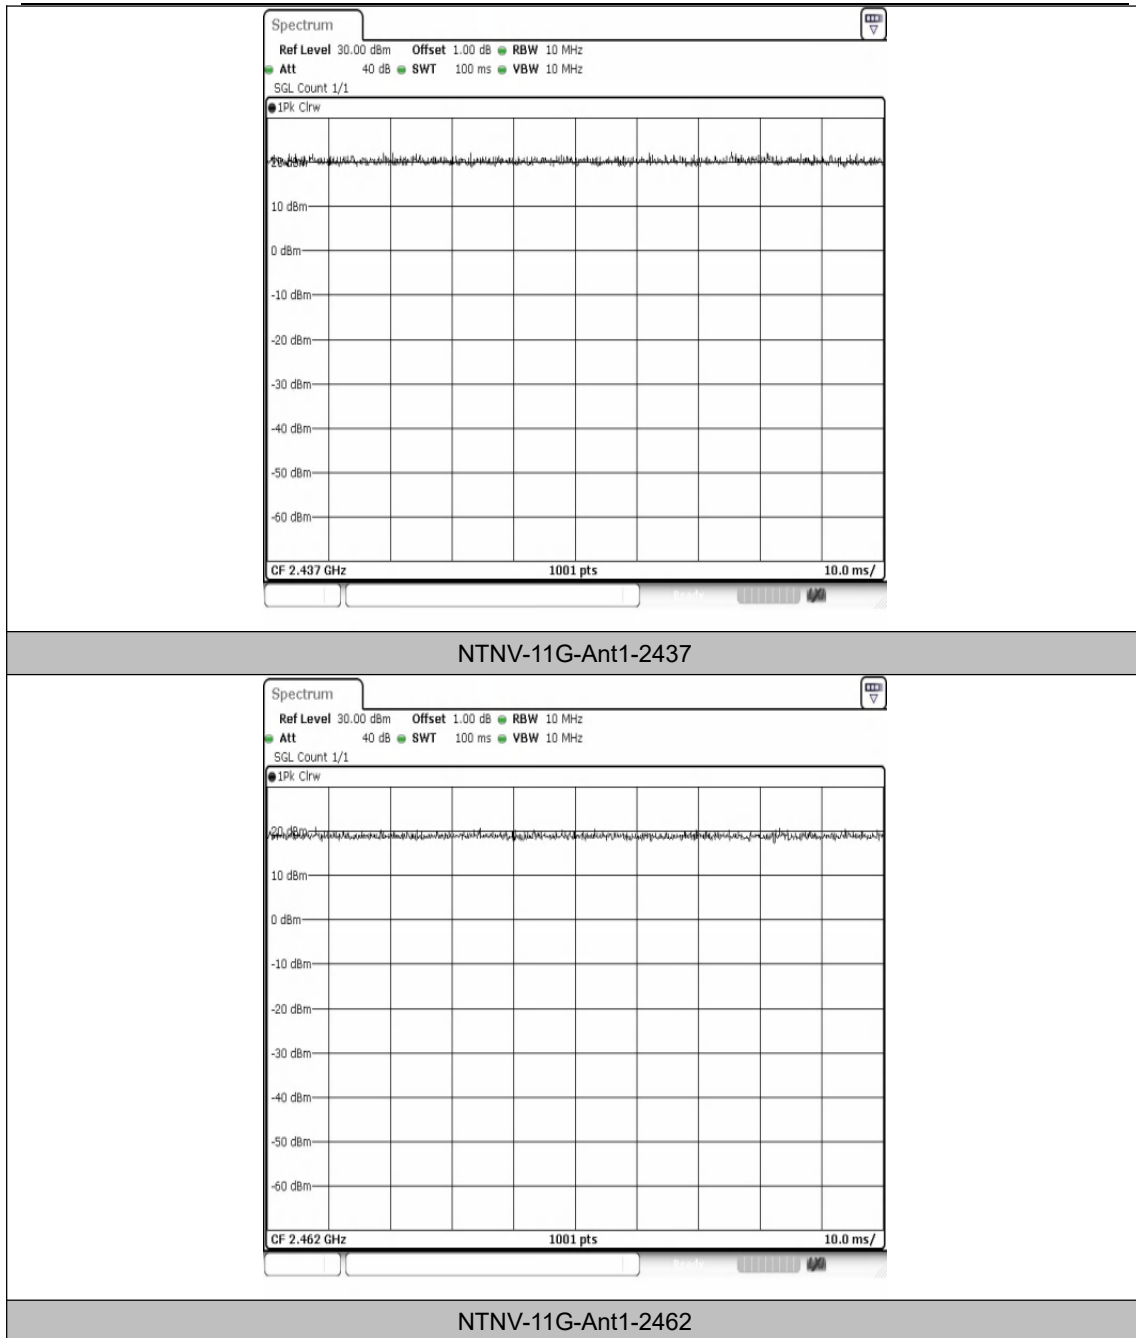

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

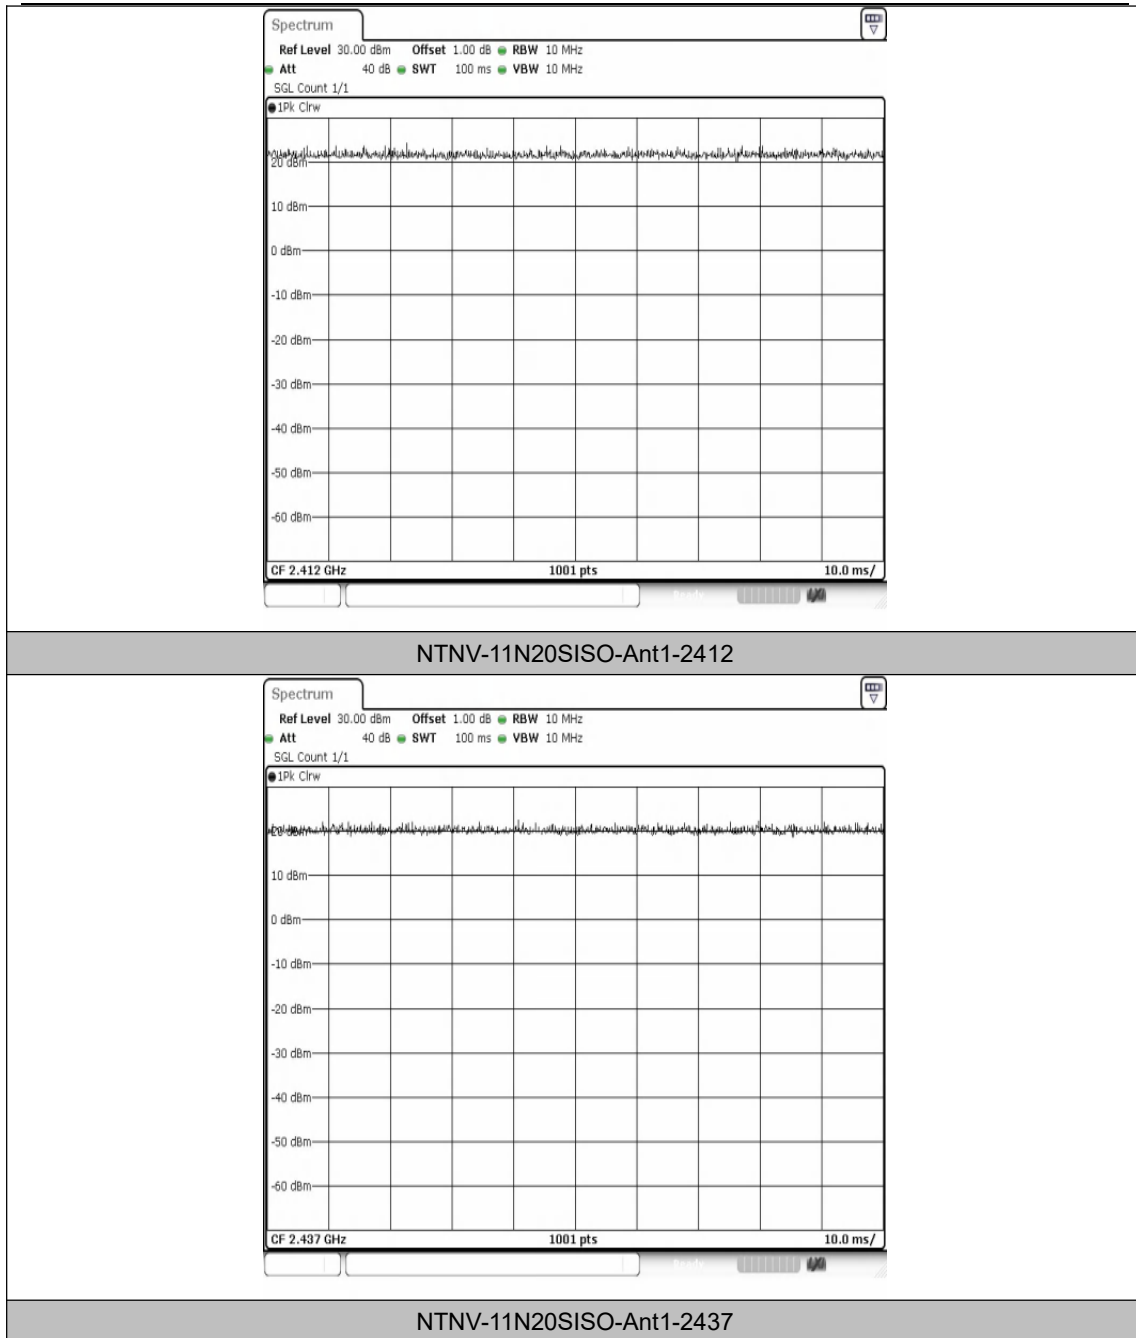

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

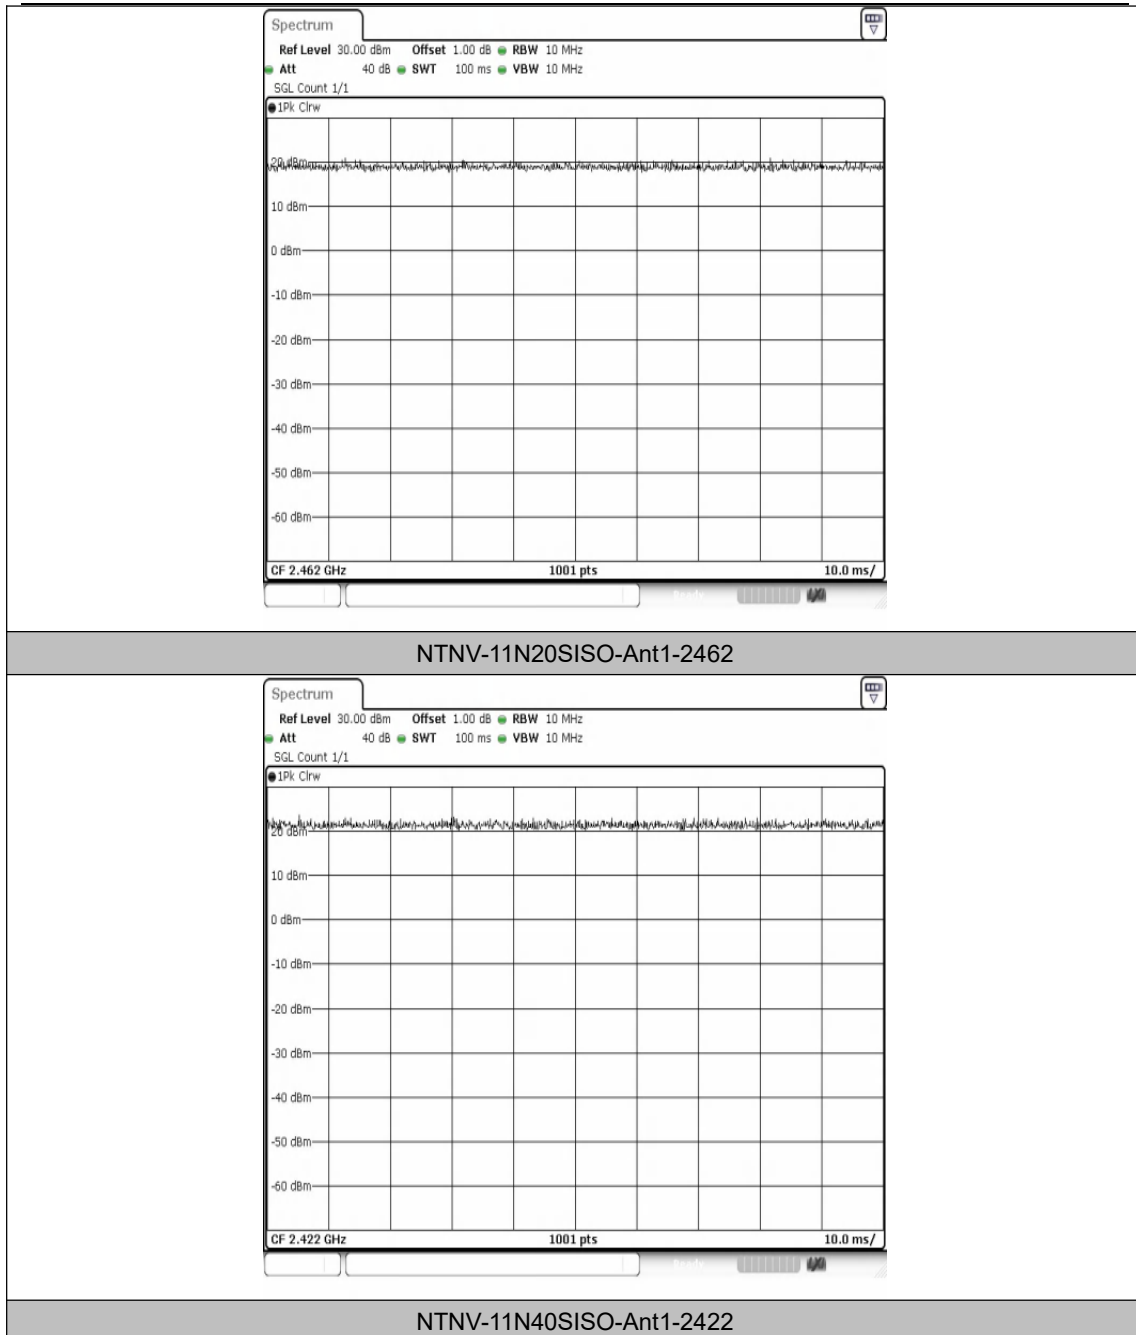

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

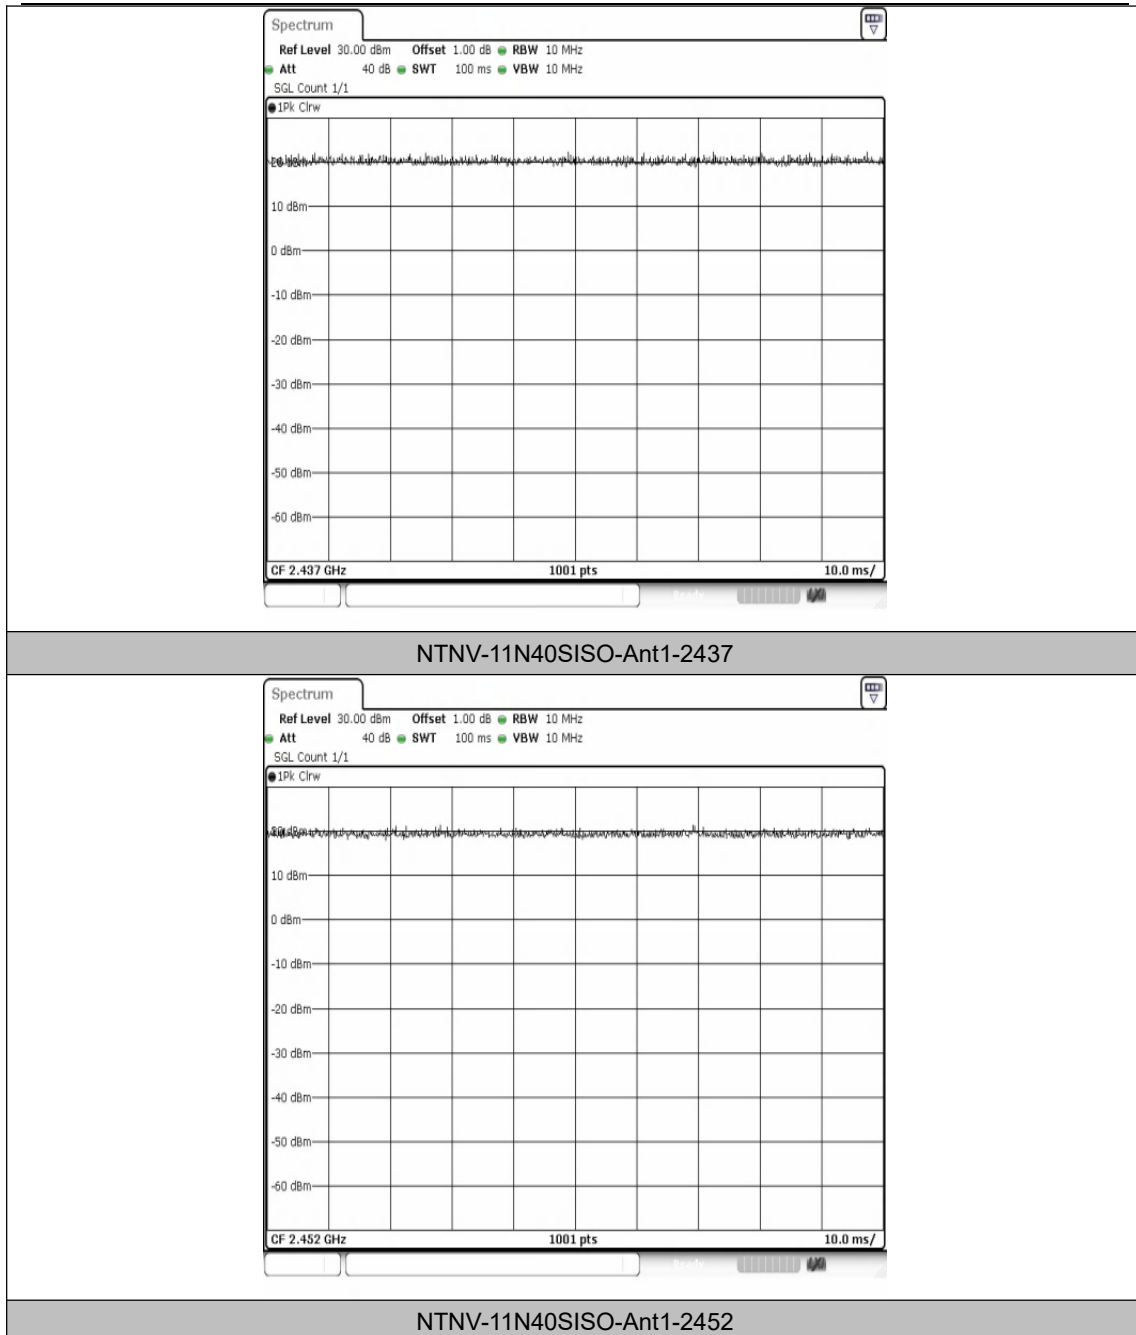

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

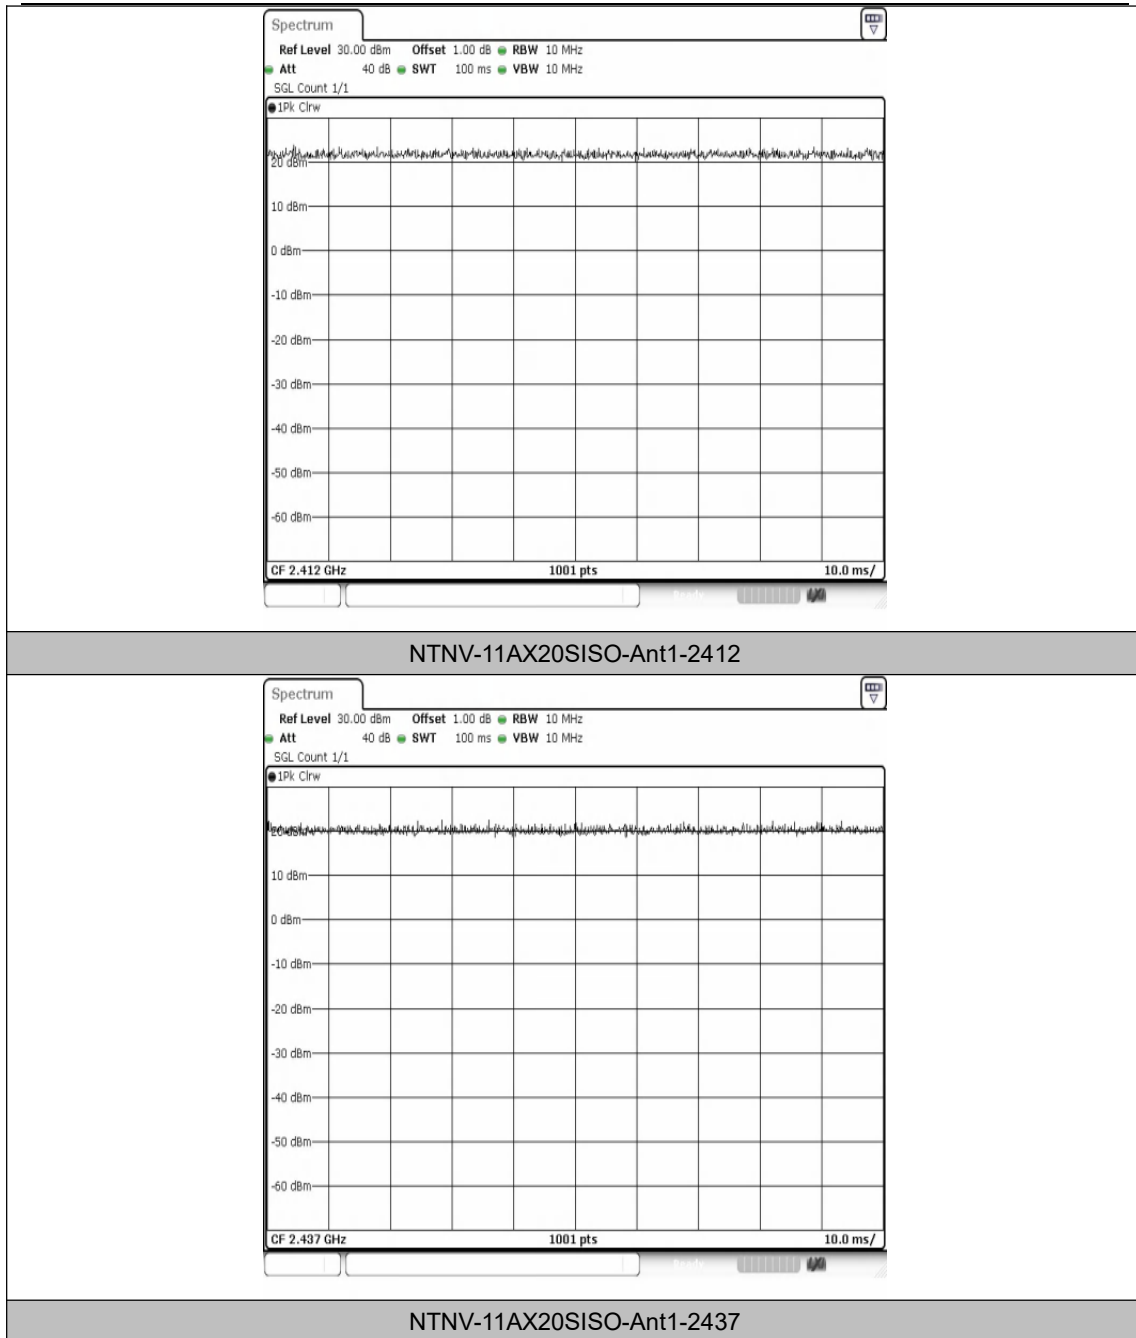

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

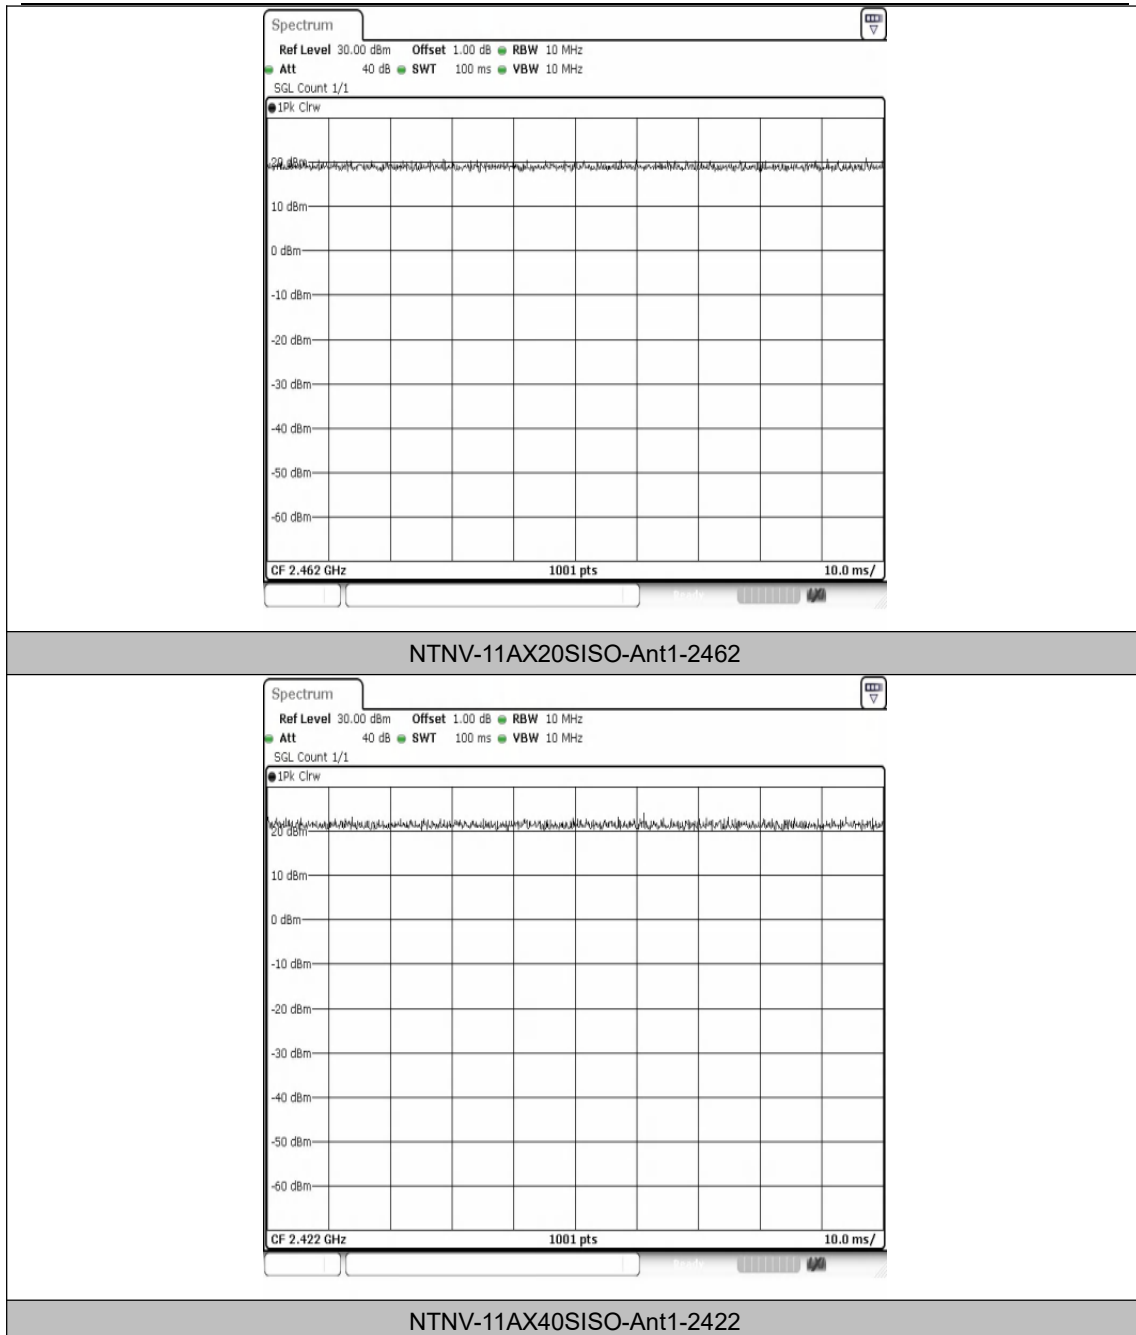

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

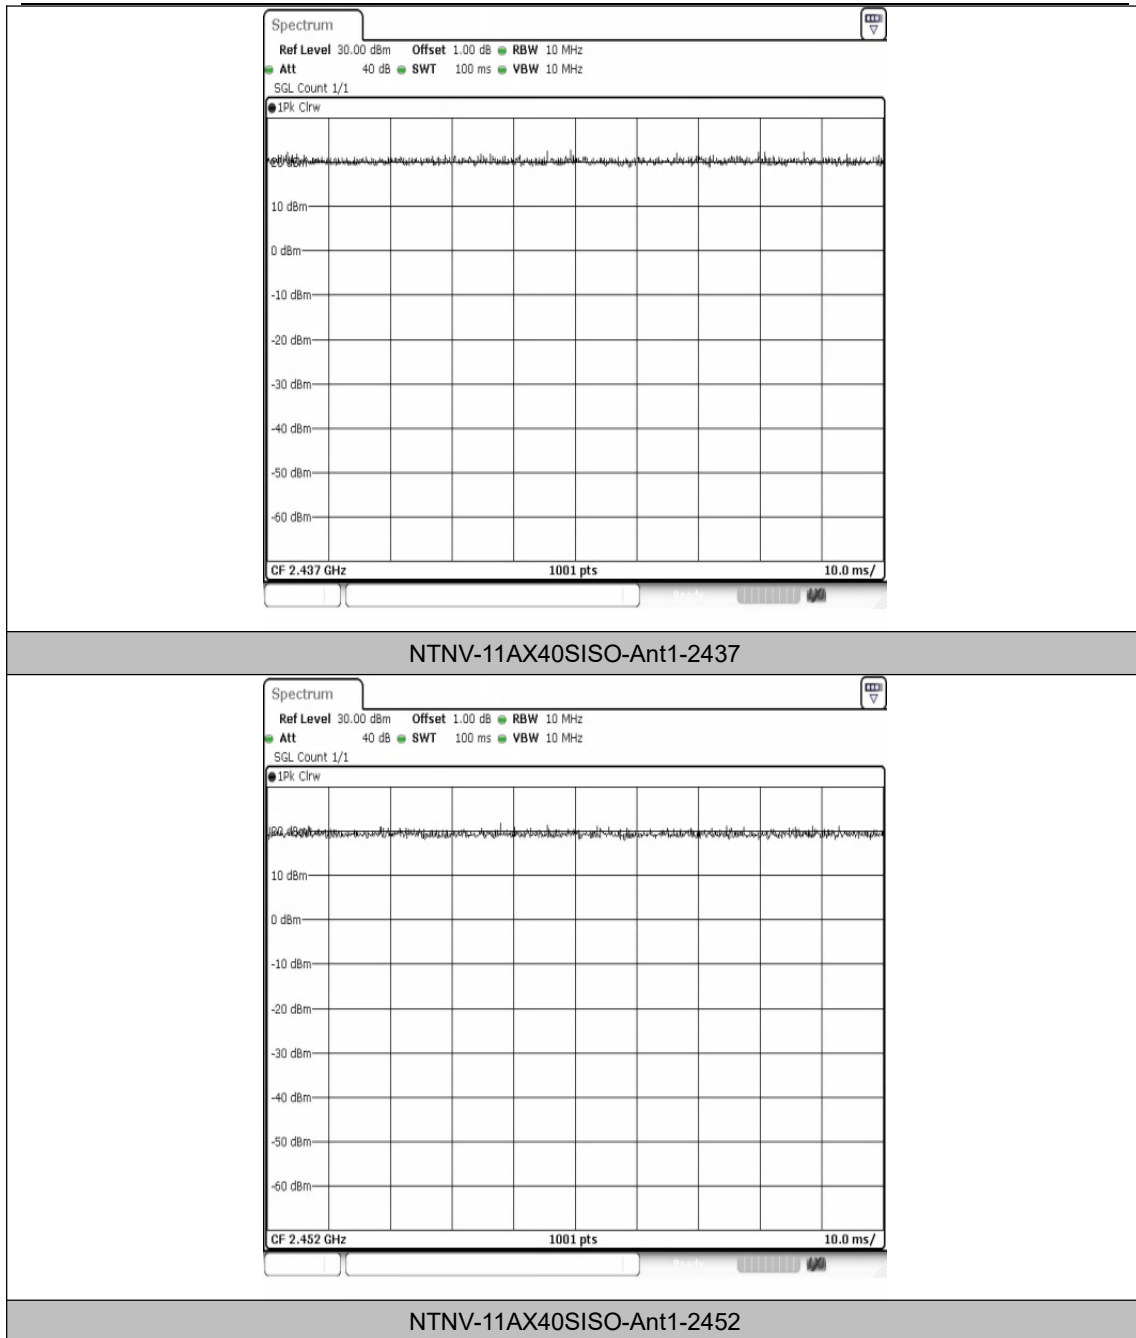

---End---