




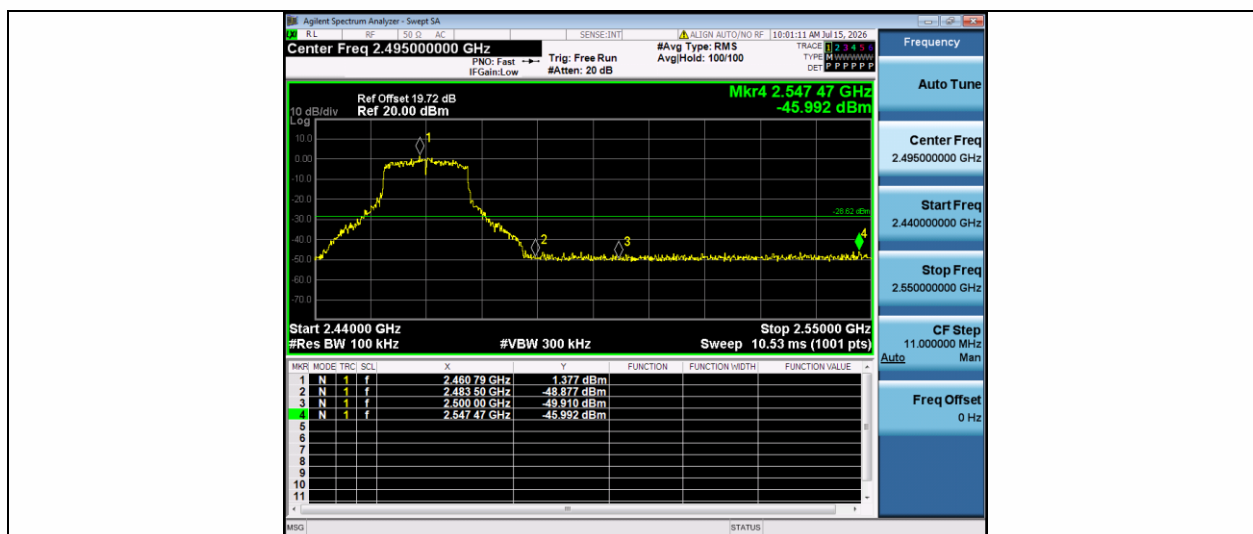


11G-Ant1-2462-PASS

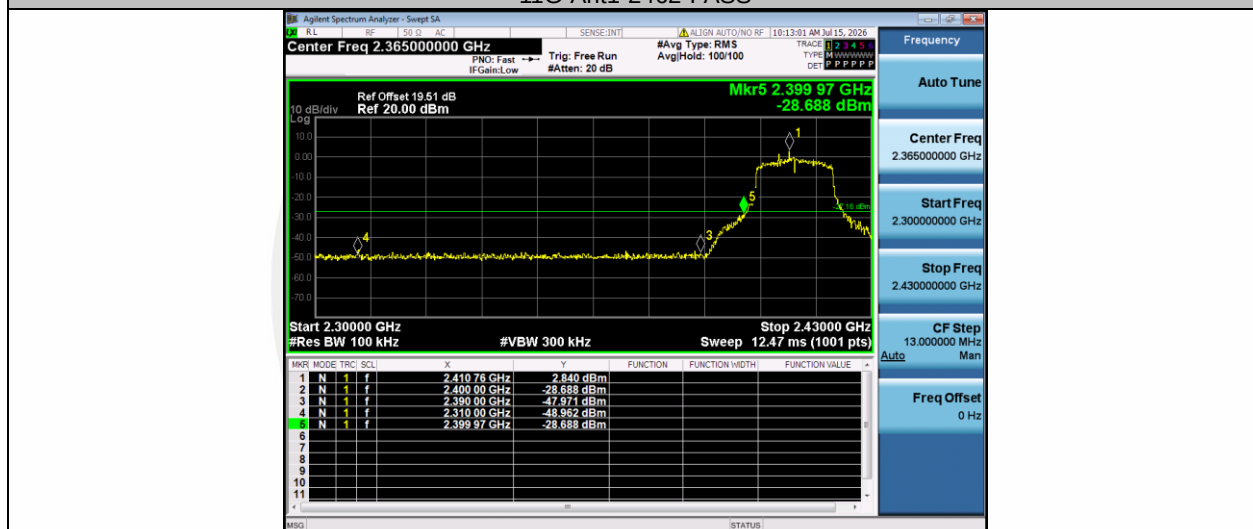


11N20SISO-Ant1-2412-PASS

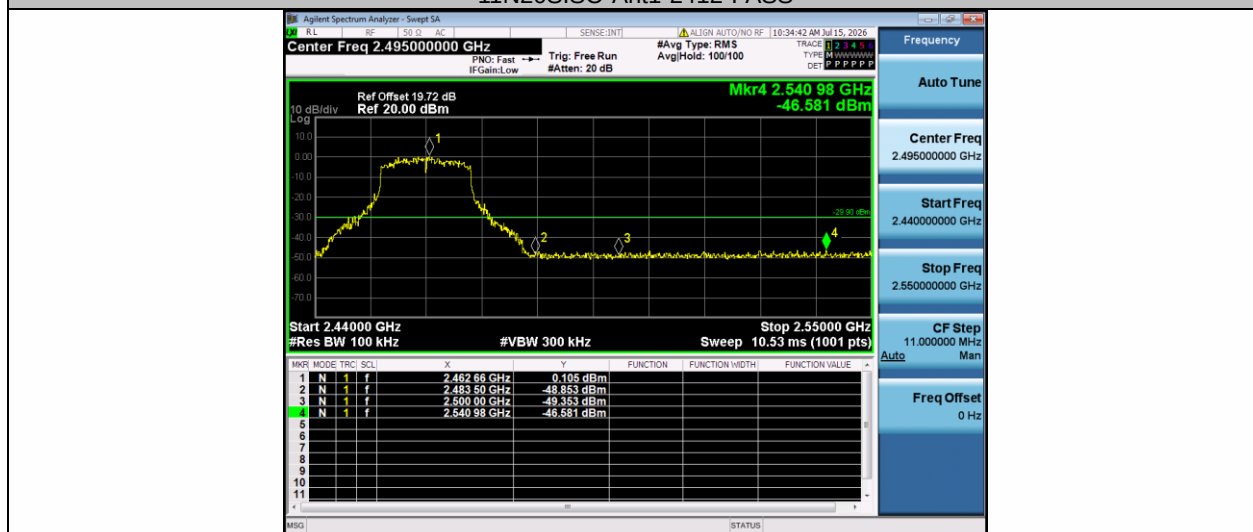


11N20SISO-Ant1-2462-PASS

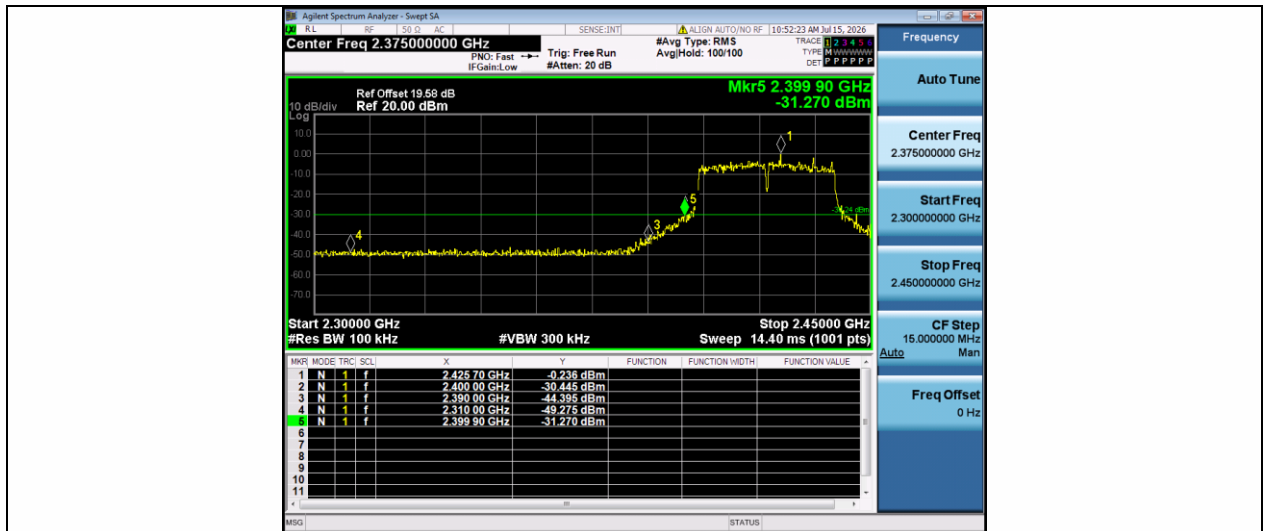

11N40SISO-Ant1-2422-PASS

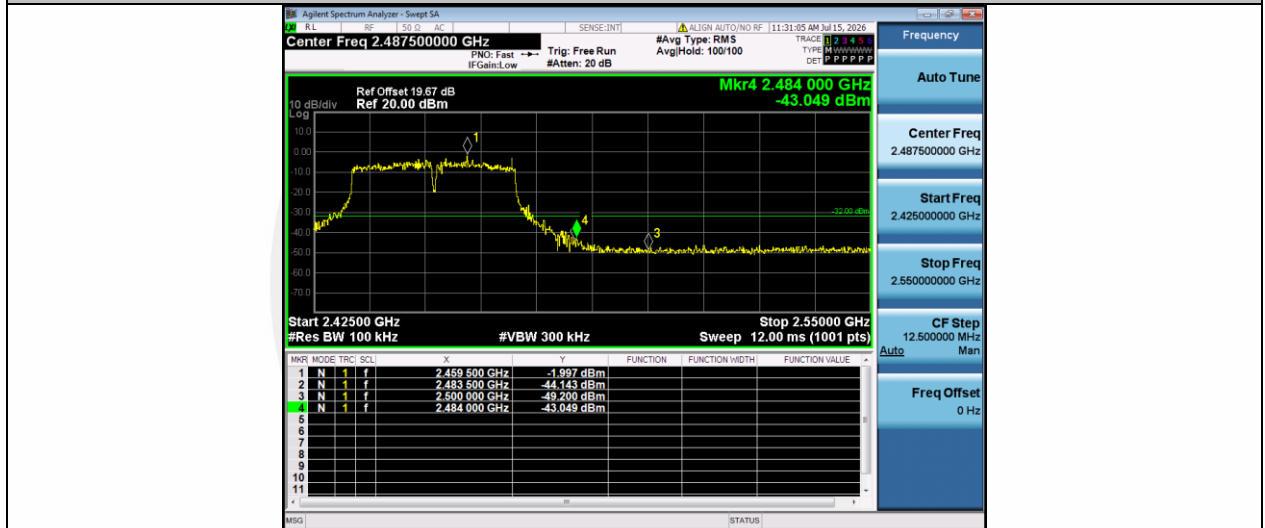


11N40SISO-Ant1-2452-PASS

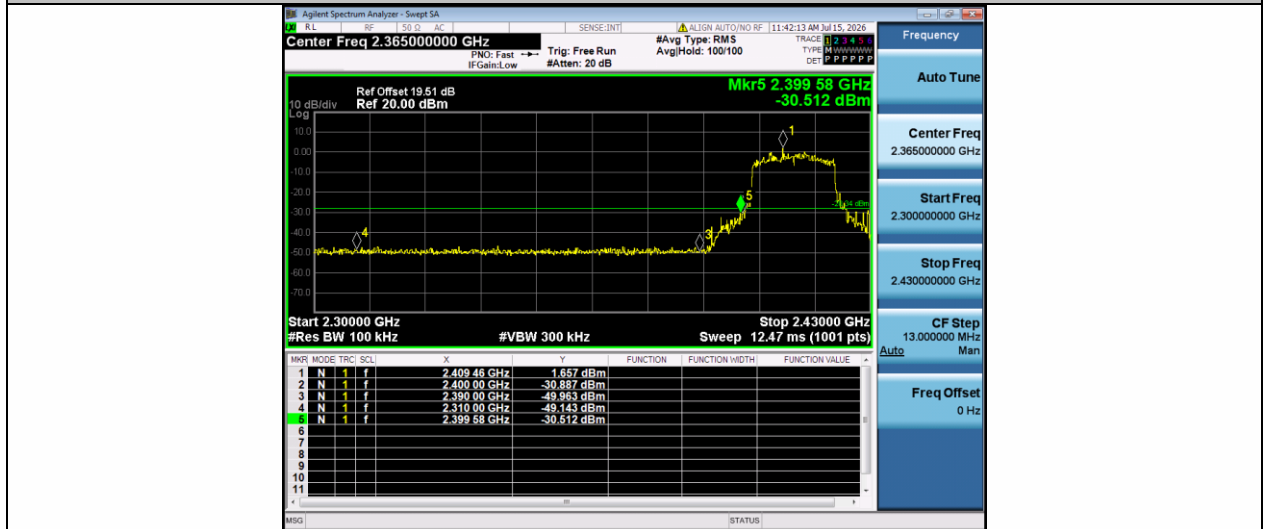


11AX20SISO-Ant1-2412-PASS



11AX20SISO-Ant1-2462-PASS

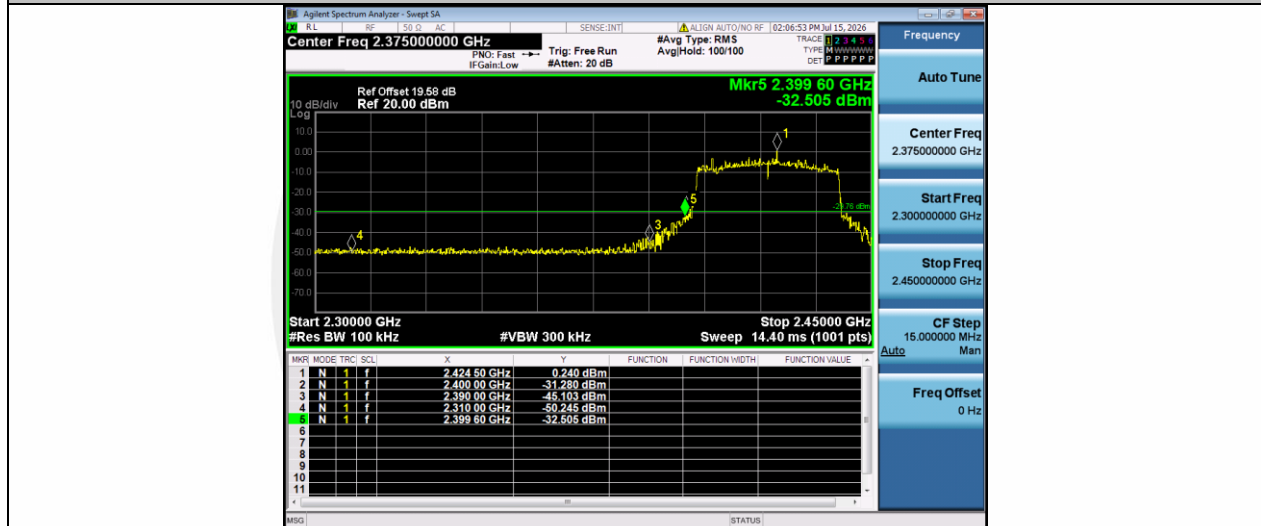

11AX40SISO-Ant1-2422-PASS

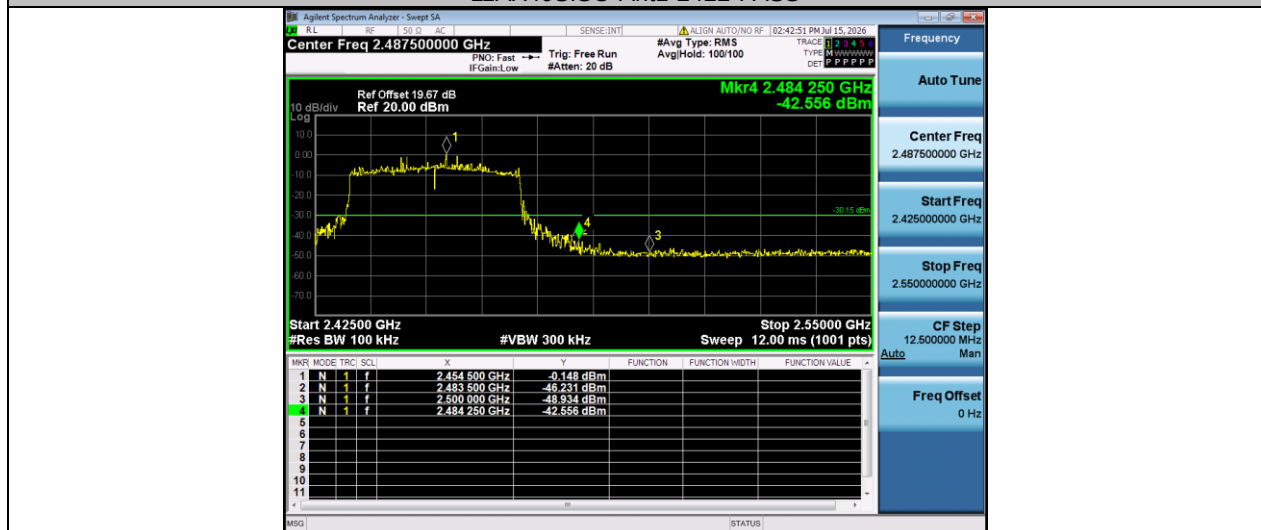


11AX40SISO-Ant1-2452-PASS

### Conducted Spurious Emission


| TestMode   | Antenna | Frequency[MHz] | FreqRange [Mhz] | RefLevel [dBm] | Result [dBm] | Limit [dBm] | Verdict |
|------------|---------|----------------|-----------------|----------------|--------------|-------------|---------|
| 11B        | Ant1    | 2412           | 0~Reference     | 4.69           | 4.69         | ---         | PASS    |
| 11B        | Ant1    | 2412           | 30~1000         | 4.69           | -56.08       | ≤-25.31     | PASS    |
| 11B        | Ant1    | 2412           | 1000~26500      | 4.69           | -28.32       | ≤-25.31     | PASS    |
| 11B        | Ant1    | 2437           | 0~Reference     | 4.42           | 4.42         | ---         | PASS    |
| 11B        | Ant1    | 2437           | 30~1000         | 4.42           | -56.56       | ≤-25.58     | PASS    |
| 11B        | Ant1    | 2437           | 1000~26500      | 4.42           | -28.67       | ≤-25.58     | PASS    |
| 11B        | Ant1    | 2462           | 0~Reference     | 5.85           | 5.85         | ---         | PASS    |
| 11B        | Ant1    | 2462           | 30~1000         | 5.85           | -57.47       | ≤-24.15     | PASS    |
| 11B        | Ant1    | 2462           | 1000~26500      | 5.85           | -29.42       | ≤-24.15     | PASS    |
| 11G        | Ant1    | 2412           | 0~Reference     | 3.64           | 3.64         | ---         | PASS    |
| 11G        | Ant1    | 2412           | 30~1000         | 3.64           | -56.7        | ≤-26.36     | PASS    |
| 11G        | Ant1    | 2412           | 1000~26500      | 3.64           | -29.65       | ≤-26.36     | PASS    |
| 11G        | Ant1    | 2437           | 0~Reference     | 2.90           | 2.90         | ---         | PASS    |
| 11G        | Ant1    | 2437           | 30~1000         | 2.90           | -57.77       | ≤-27.1      | PASS    |
| 11G        | Ant1    | 2437           | 1000~26500      | 2.90           | -29.04       | ≤-27.1      | PASS    |
| 11G        | Ant1    | 2462           | 0~Reference     | 3.11           | 3.11         | ---         | PASS    |
| 11G        | Ant1    | 2462           | 30~1000         | 3.11           | -57.05       | ≤-26.89     | PASS    |
| 11G        | Ant1    | 2462           | 1000~26500      | 3.11           | -28.37       | ≤-26.89     | PASS    |
| 11N20SISO  | Ant1    | 2412           | 0~Reference     | 3.15           | 3.15         | ---         | PASS    |
| 11N20SISO  | Ant1    | 2412           | 30~1000         | 3.15           | -57.1        | ≤-26.85     | PASS    |
| 11N20SISO  | Ant1    | 2412           | 1000~26500      | 3.15           | -29.1        | ≤-26.85     | PASS    |
| 11N20SISO  | Ant1    | 2437           | 0~Reference     | 2.14           | 2.14         | ---         | PASS    |
| 11N20SISO  | Ant1    | 2437           | 30~1000         | 2.14           | -57.32       | ≤-27.86     | PASS    |
| 11N20SISO  | Ant1    | 2437           | 1000~26500      | 2.14           | -29.54       | ≤-27.86     | PASS    |
| 11N20SISO  | Ant1    | 2462           | 0~Reference     | 2.76           | 2.76         | ---         | PASS    |
| 11N20SISO  | Ant1    | 2462           | 30~1000         | 2.76           | -57.68       | ≤-27.24     | PASS    |
| 11N20SISO  | Ant1    | 2462           | 1000~26500      | 2.76           | -29.2        | ≤-27.24     | PASS    |
| 11N40SISO  | Ant1    | 2422           | 0~Reference     | 0.48           | 0.48         | ---         | PASS    |
| 11N40SISO  | Ant1    | 2422           | 30~1000         | 0.48           | -56.53       | ≤-29.52     | PASS    |
| 11N40SISO  | Ant1    | 2422           | 1000~26500      | 0.48           | -42.12       | ≤-29.52     | PASS    |
| 11N40SISO  | Ant1    | 2437           | 0~Reference     | -0.39          | -0.39        | ---         | PASS    |
| 11N40SISO  | Ant1    | 2437           | 30~1000         | -0.39          | -57.53       | ≤-30.39     | PASS    |
| 11N40SISO  | Ant1    | 2437           | 1000~26500      | -0.39          | -42.01       | ≤-30.39     | PASS    |
| 11N40SISO  | Ant1    | 2452           | 0~Reference     | -0.65          | -0.65        | ---         | PASS    |
| 11N40SISO  | Ant1    | 2452           | 30~1000         | -0.65          | -56.98       | ≤-30.65     | PASS    |
| 11N40SISO  | Ant1    | 2452           | 1000~26500      | -0.65          | -42.44       | ≤-30.65     | PASS    |
| 11AX20SISO | Ant1    | 2412           | 0~Reference     | 1.94           | 1.94         | ---         | PASS    |
| 11AX20SISO | Ant1    | 2412           | 30~1000         | 1.94           | -57.34       | ≤-28.06     | PASS    |
| 11AX20SISO | Ant1    | 2412           | 1000~26500      | 1.94           | -29.06       | ≤-28.06     | PASS    |
| 11AX20SISO | Ant1    | 2437           | 0~Reference     | 2.26           | 2.26         | ---         | PASS    |
| 11AX20SISO | Ant1    | 2437           | 30~1000         | 2.26           | -57.89       | ≤-27.74     | PASS    |
| 11AX20SISO | Ant1    | 2437           | 1000~26500      | 2.26           | -28.89       | ≤-27.74     | PASS    |
| 11AX20SISO | Ant1    | 2462           | 0~Reference     | 4.27           | 4.27         | ---         | PASS    |
| 11AX20SISO | Ant1    | 2462           | 30~1000         | 4.27           | -57.79       | ≤-25.73     | PASS    |
| 11AX20SISO | Ant1    | 2462           | 1000~26500      | 4.27           | -29          | ≤-25.73     | PASS    |
| 11AX40SISO | Ant1    | 2422           | 0~Reference     | -0.02          | -0.02        | ---         | PASS    |
| 11AX40SISO | Ant1    | 2422           | 30~1000         | -0.02          | -57.3        | ≤-30.02     | PASS    |
| 11AX40SISO | Ant1    | 2422           | 1000~26500      | -0.02          | -42.72       | ≤-30.02     | PASS    |
| 11AX40SISO | Ant1    | 2437           | 0~Reference     | -0.06          | -0.06        | ---         | PASS    |
| 11AX40SISO | Ant1    | 2437           | 30~1000         | -0.06          | -56.4        | ≤-30.06     | PASS    |
| 11AX40SISO | Ant1    | 2437           | 1000~26500      | -0.06          | -41.89       | ≤-30.06     | PASS    |
| 11AX40SISO | Ant1    | 2452           | 0~Reference     | -0.05          | -0.05        | ---         | PASS    |
| 11AX40SISO | Ant1    | 2452           | 30~1000         | -0.05          | -57.93       | ≤-30.05     | PASS    |
| 11AX40SISO | Ant1    | 2452           | 1000~26500      | -0.05          | -41.55       | ≤-30.05     | PASS    |



11B-Ant1-2412-0~Reference-PASS

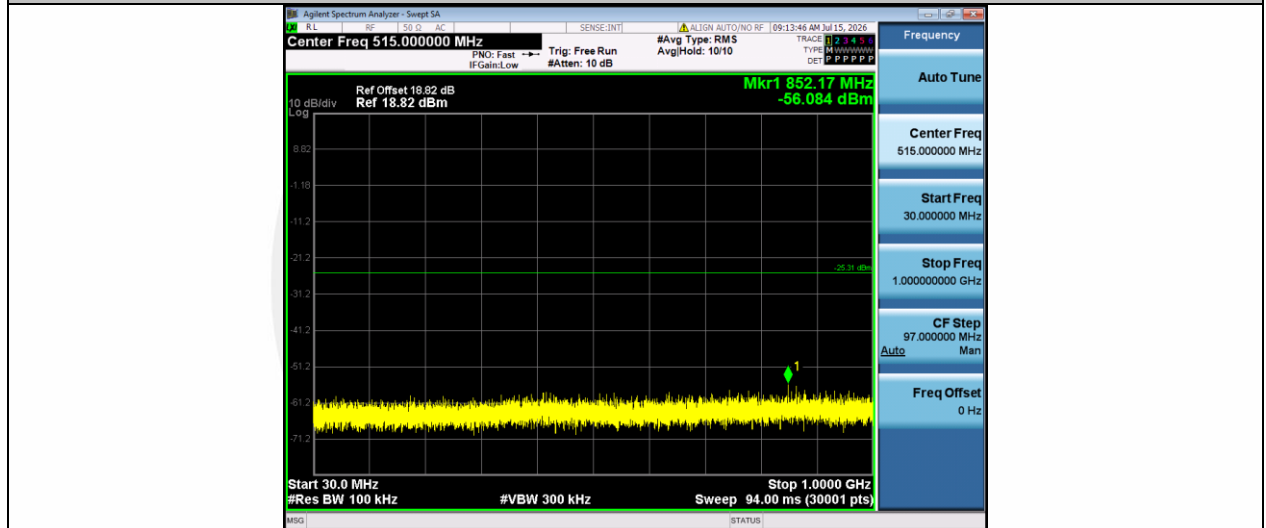


11B-Ant1-2412-30~1000-PASS

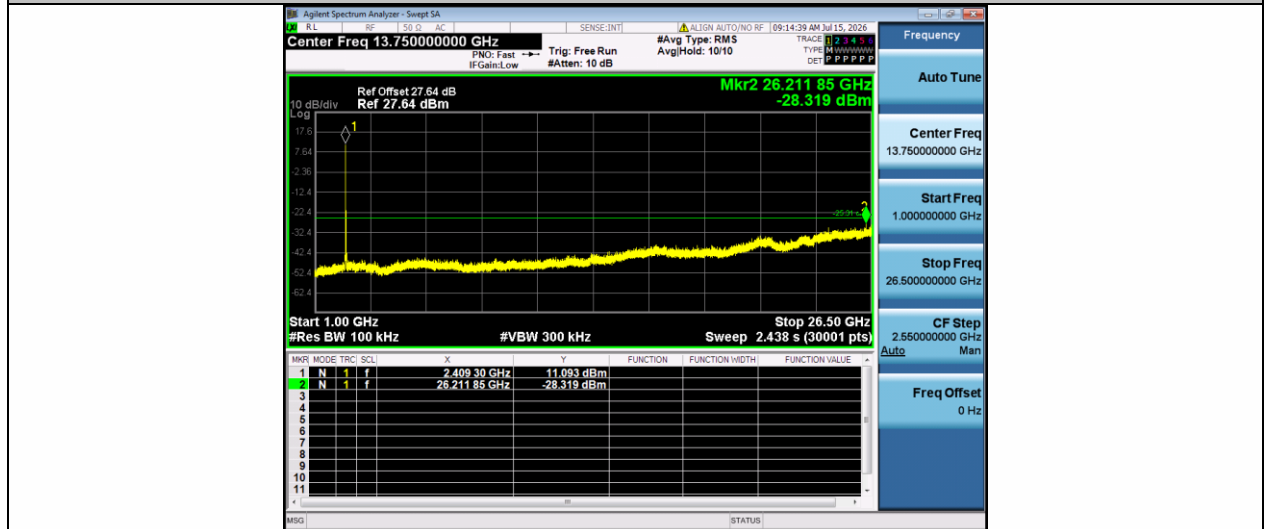


11B-Ant1-2412-1000~26500-PASS




11B-Ant1-2437-0~Reference-PASS

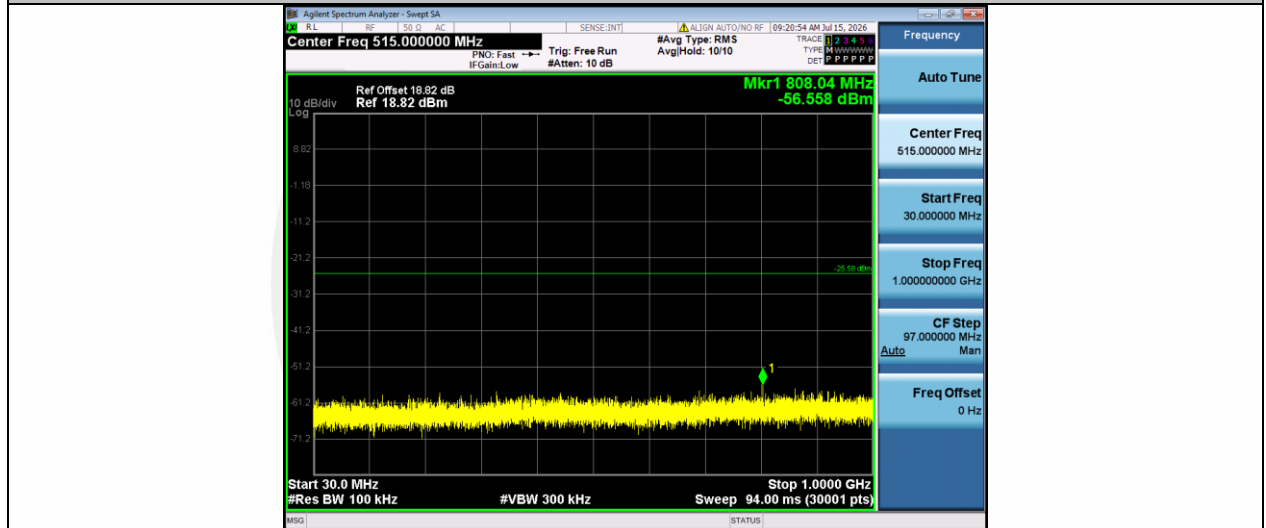


11B-Ant1-2437-30~1000-PASS

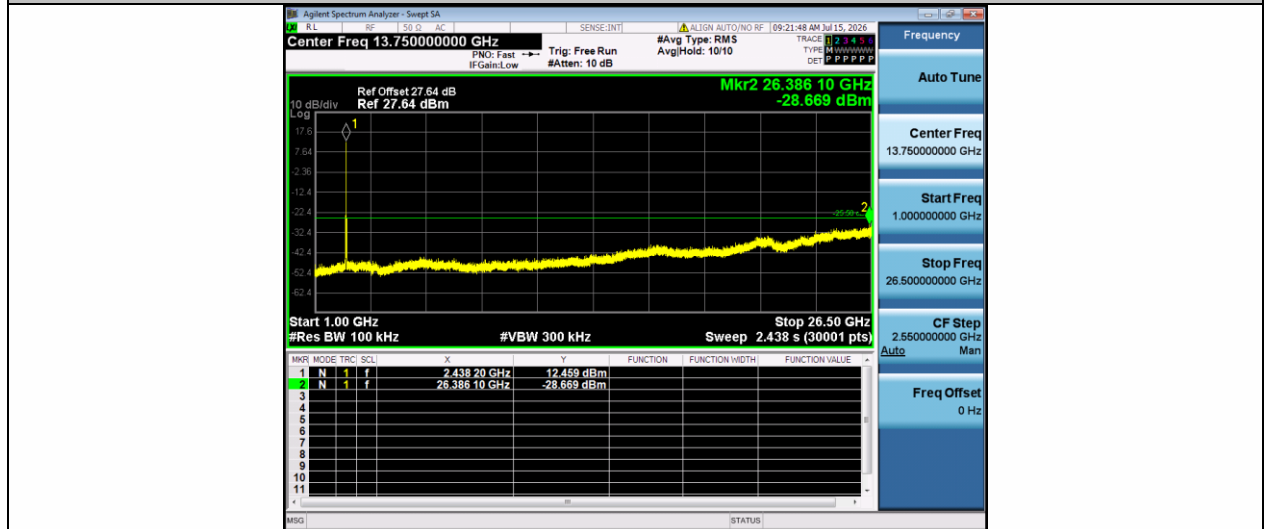


11B-Ant1-2437-1000~26500-PASS

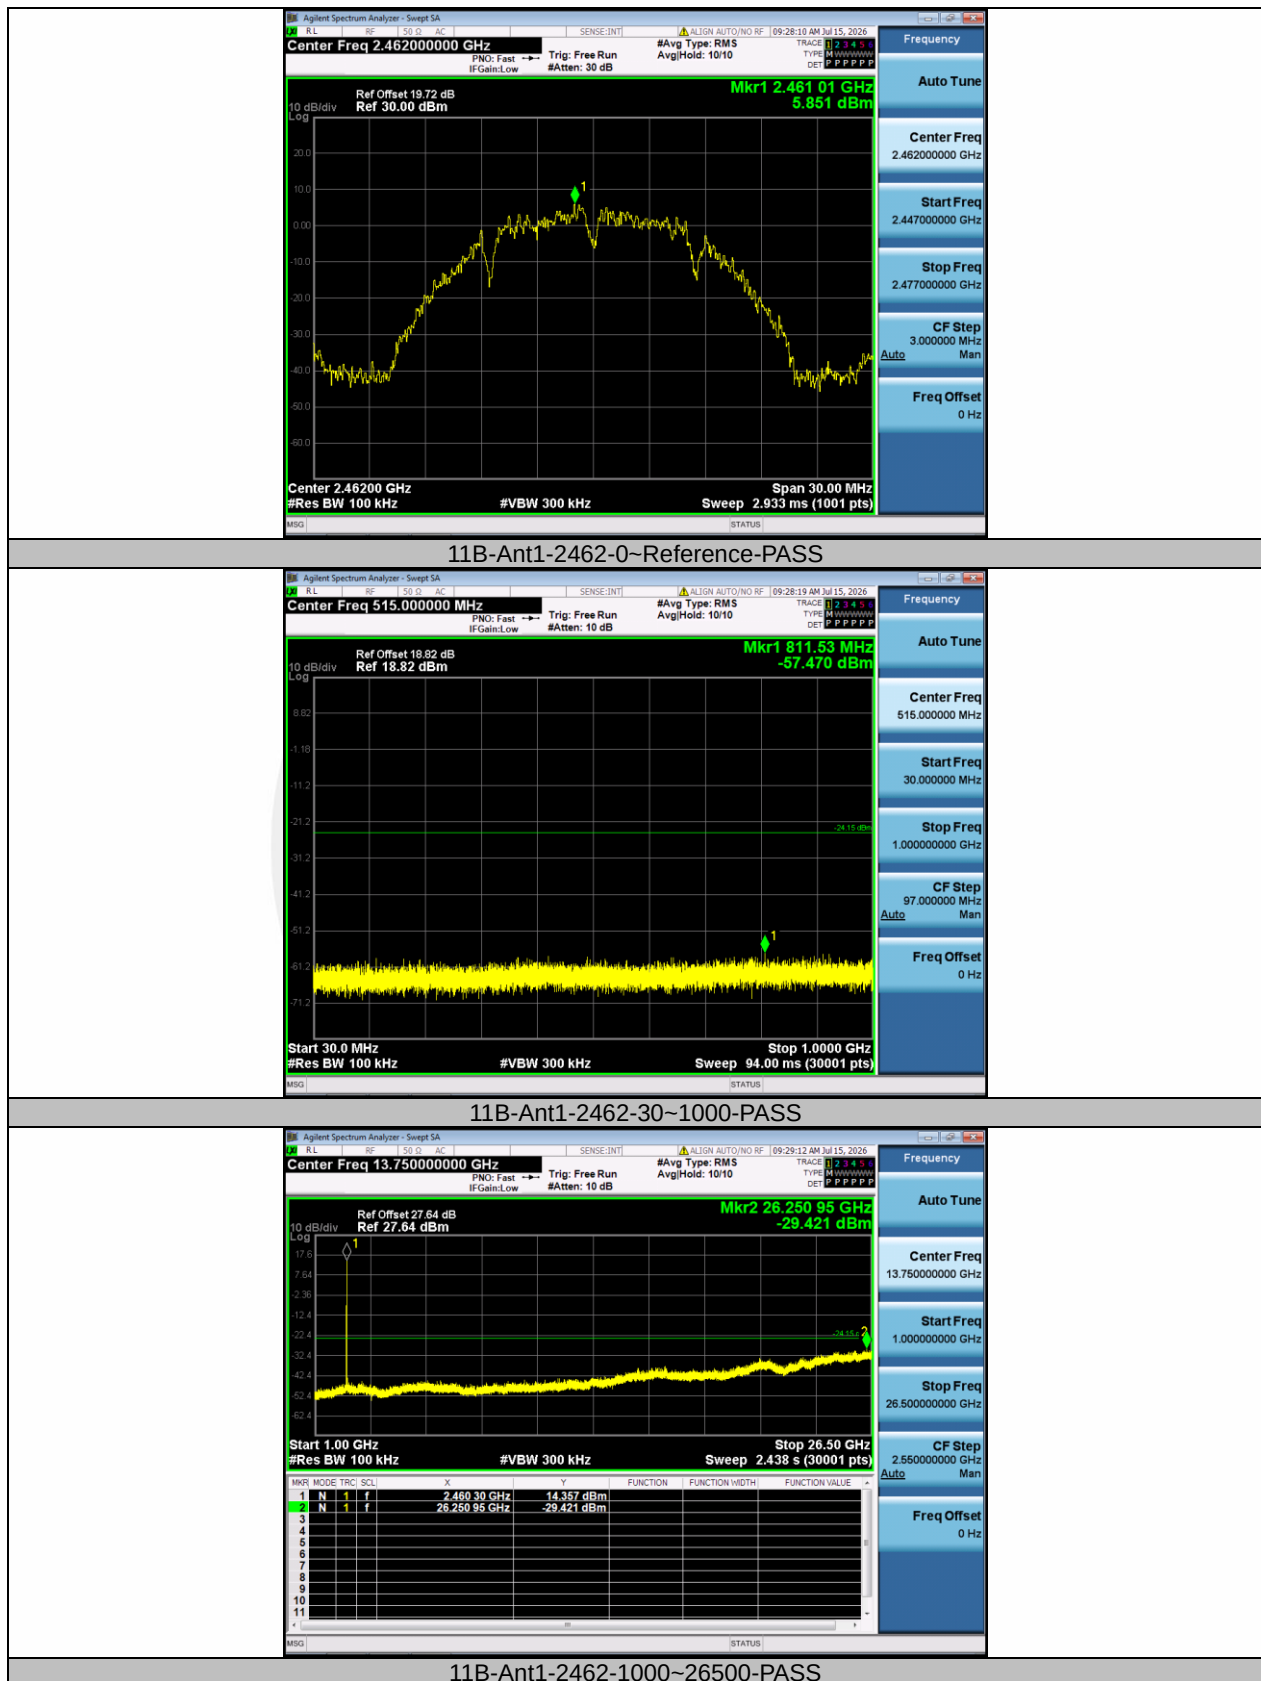


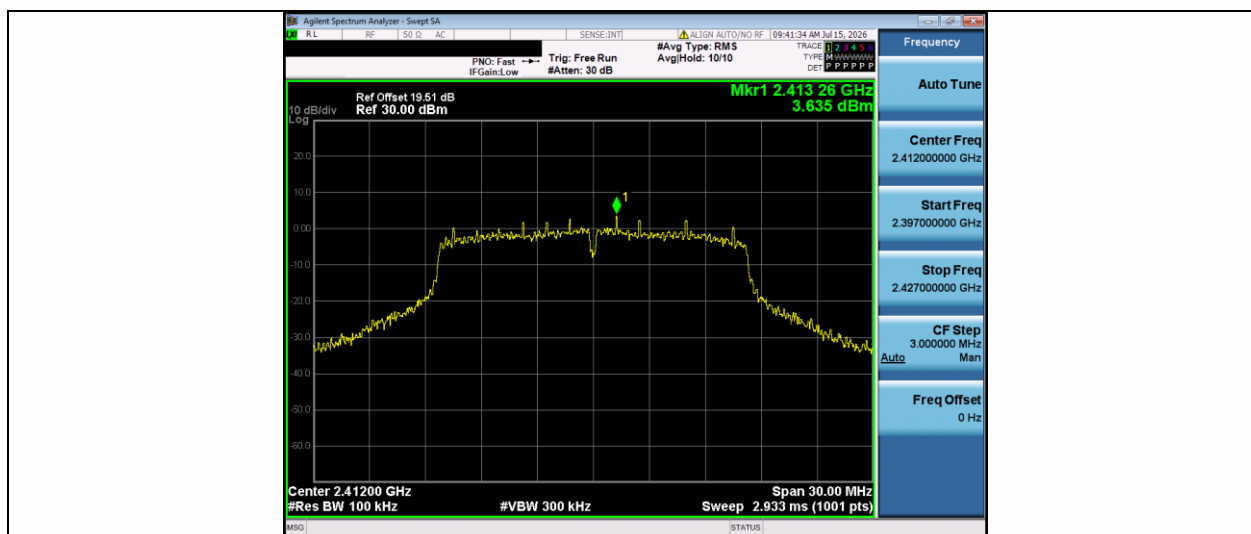


11G-Ant1-2412-0~Reference-PASS

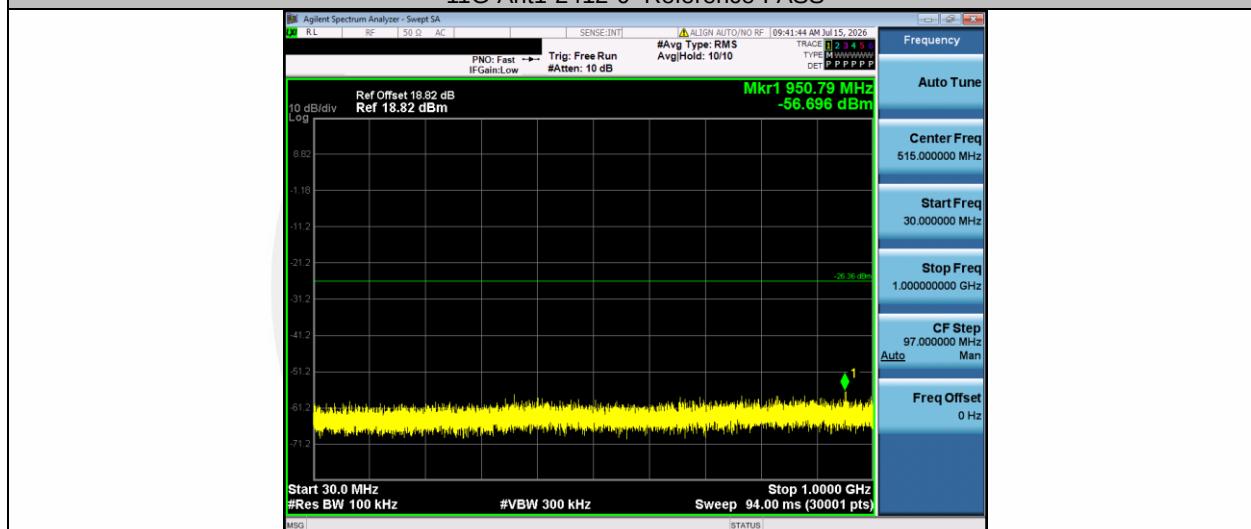

11G-Ant1-2412-30~1000-PASS

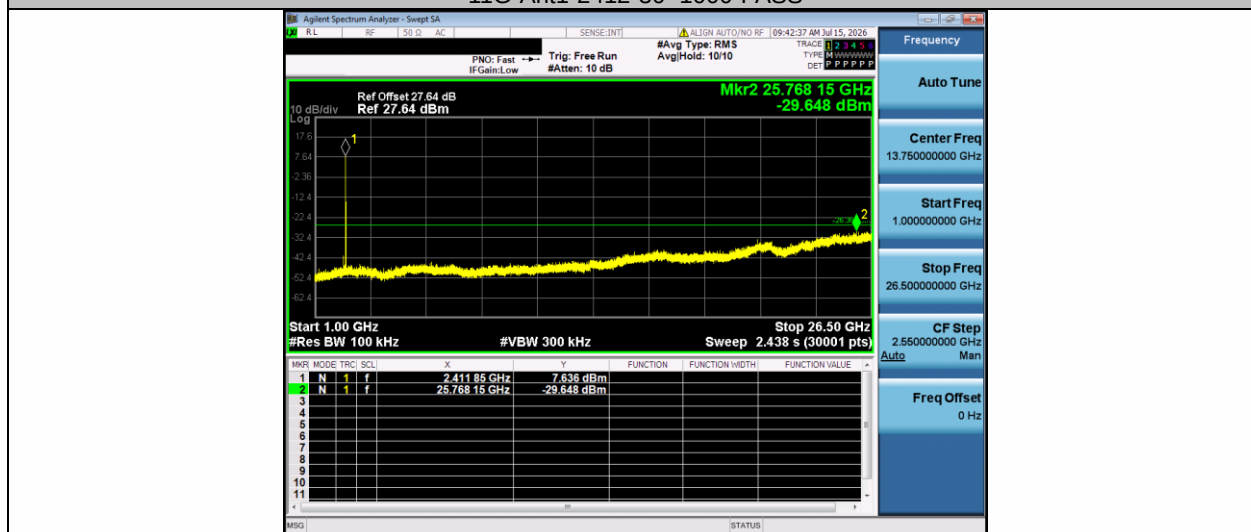


11G-Ant1-2412-1000~26500-PASS

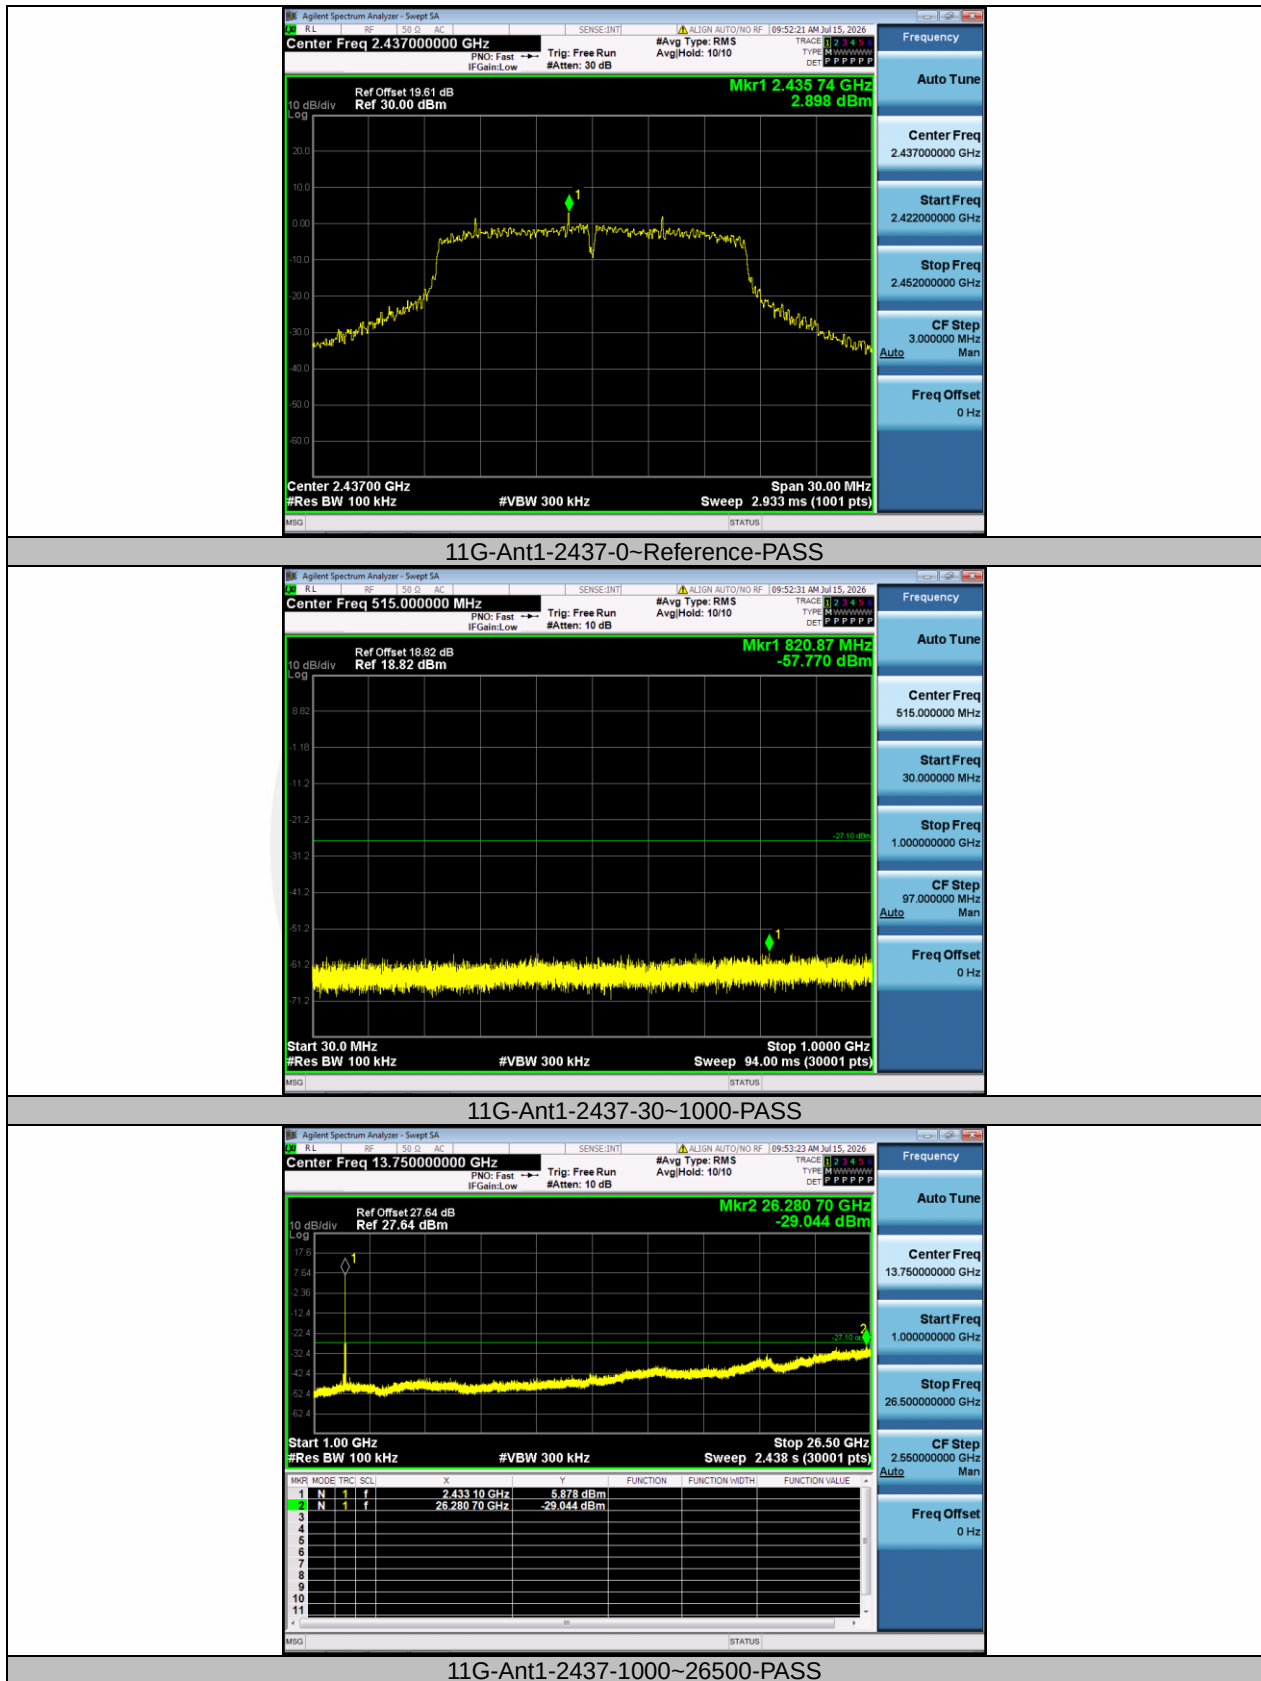




11G-Ant1-2462-0~Reference-PASS

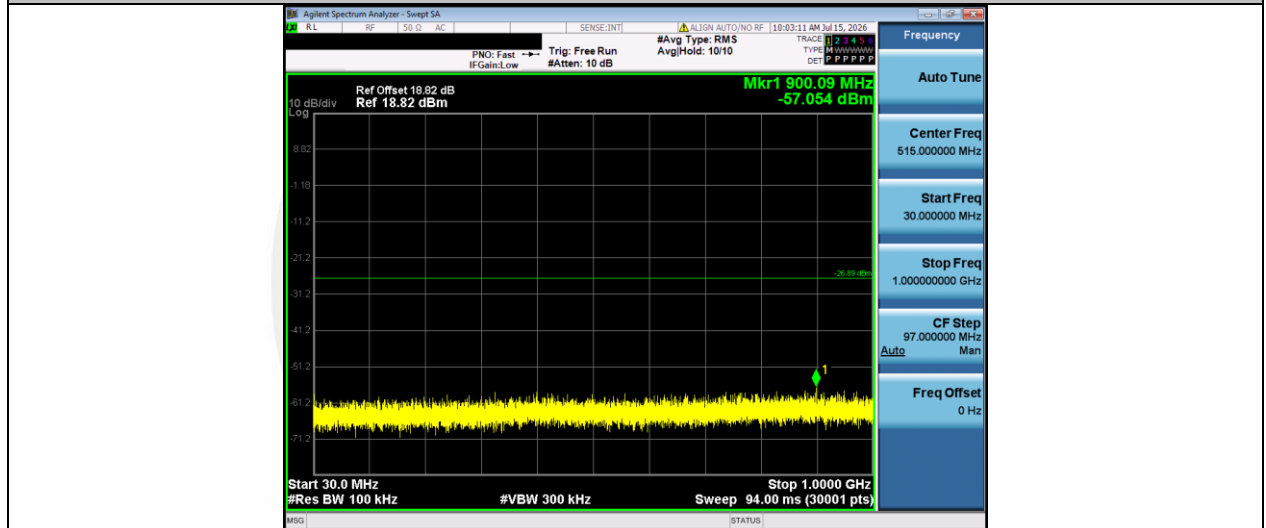

11G-Ant1-2462-30~1000-PASS

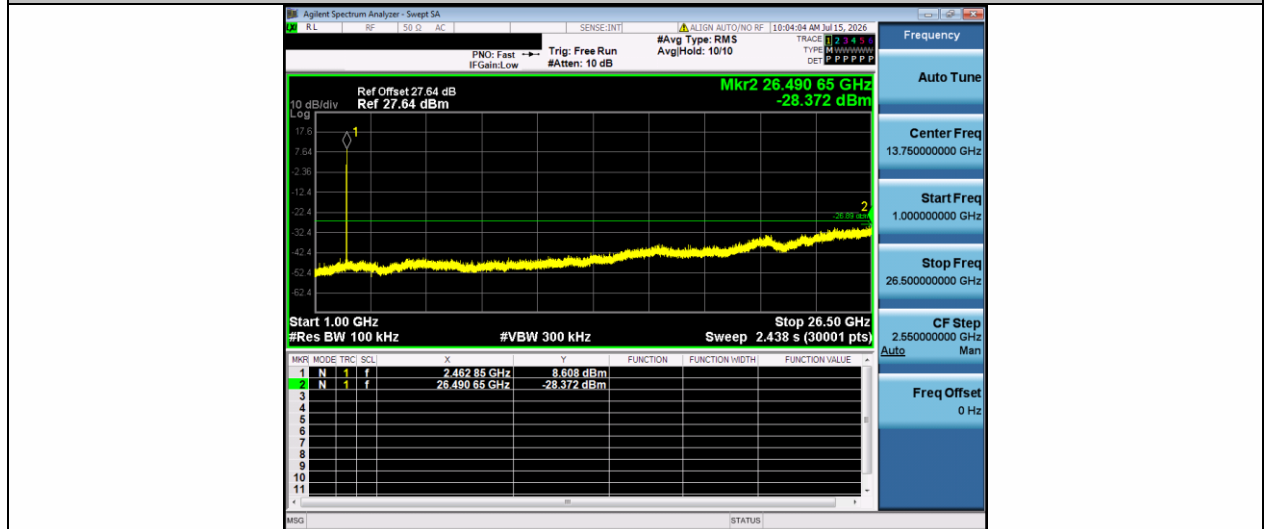

11G-Ant1-2462-1000~26500-PASS

