

Appendix Test Data

Report No.:	1821C60019112502-01	Test Sample No.:	1-2-2
Start Test Date:	2026-7-17	Finish Test Date:	2026-7-21
Test Engineer:	Pearl Ao	Auditor:	Justin Feng
Temperature:	25.5°C	Relative Humidity:	67%
Pressure:	100.1kPa		



Appendix A1: 26dB Bandwidth

Test Result

Test Mode	Antenna	Frequency[MHz]	26db EBW [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5745	28.120	5730.760	5758.880	---	---
11A	Ant1	5785	26.160	5771.480	5797.640	---	---
11A	Ant1	5825	27.720	5810.880	5838.600	---	---
11N20SISO	Ant1	5745	28.600	5730.200	5758.800	---	---
11N20SISO	Ant1	5785	27.640	5771.480	5799.120	---	---
11N20SISO	Ant1	5825	27.240	5811.400	5838.640	---	---
11N40SISO	Ant1	5755	48.000	5730.920	5778.920	---	---
11N40SISO	Ant1	5795	47.040	5771.320	5818.360	---	---
11AC20SISO	Ant1	5745	27.640	5731.160	5758.800	---	---
11AC20SISO	Ant1	5785	29.800	5769.640	5799.440	---	---
11AC20SISO	Ant1	5825	28.080	5810.920	5839.000	---	---
11AC40SISO	Ant1	5755	48.960	5729.400	5778.360	---	---
11AC40SISO	Ant1	5795	48.320	5770.360	5818.680	---	---
11AC80SISO	Ant1	5775	89.760	5729.880	5819.640	---	---


Test Graphs



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

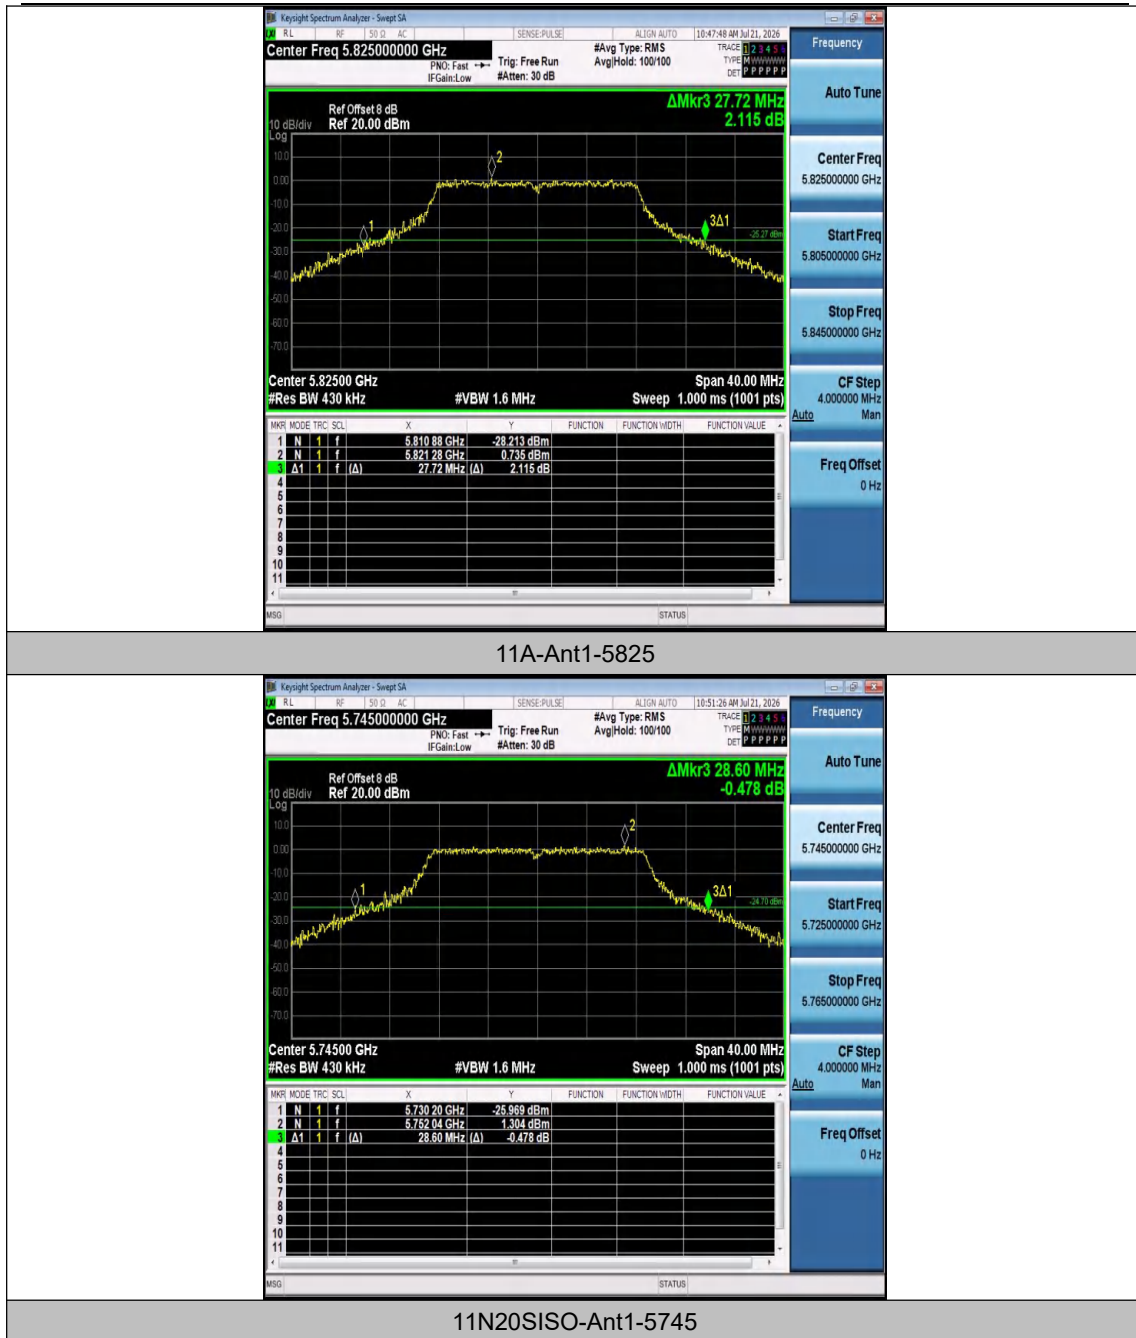

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix A2: 99% Occupied Bandwidth

Test Result

Test Mode	Antenna	Frequency[MHz]	OCB [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5745	17.738	5736.0561	5753.7941	---	---
11A	Ant1	5785	17.686	5776.0517	5793.7377	---	---
11A	Ant1	5825	17.667	5816.1464	5833.8134	---	---
11N20SISO	Ant1	5745	18.868	5735.5393	5754.4073	---	---
11N20SISO	Ant1	5785	18.763	5775.6281	5794.3911	---	---
11N20SISO	Ant1	5825	18.889	5815.5514	5834.4404	---	---
11N40SISO	Ant1	5755	37.292	5736.3644	5773.6564	---	---
11N40SISO	Ant1	5795	37.197	5776.4426	5813.6396	---	---
11AC20SISO	Ant1	5745	18.808	5735.5808	5754.3888	---	---
11AC20SISO	Ant1	5785	18.713	5775.6554	5794.3684	---	---
11AC20SISO	Ant1	5825	18.765	5815.6152	5834.3802	---	---
11AC40SISO	Ant1	5755	37.196	5736.4032	5773.5992	---	---
11AC40SISO	Ant1	5795	37.170	5776.4543	5813.6243	---	---
11AC80SISO	Ant1	5775	76.618	5736.7926	5813.4106	---	---


Test Graphs



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

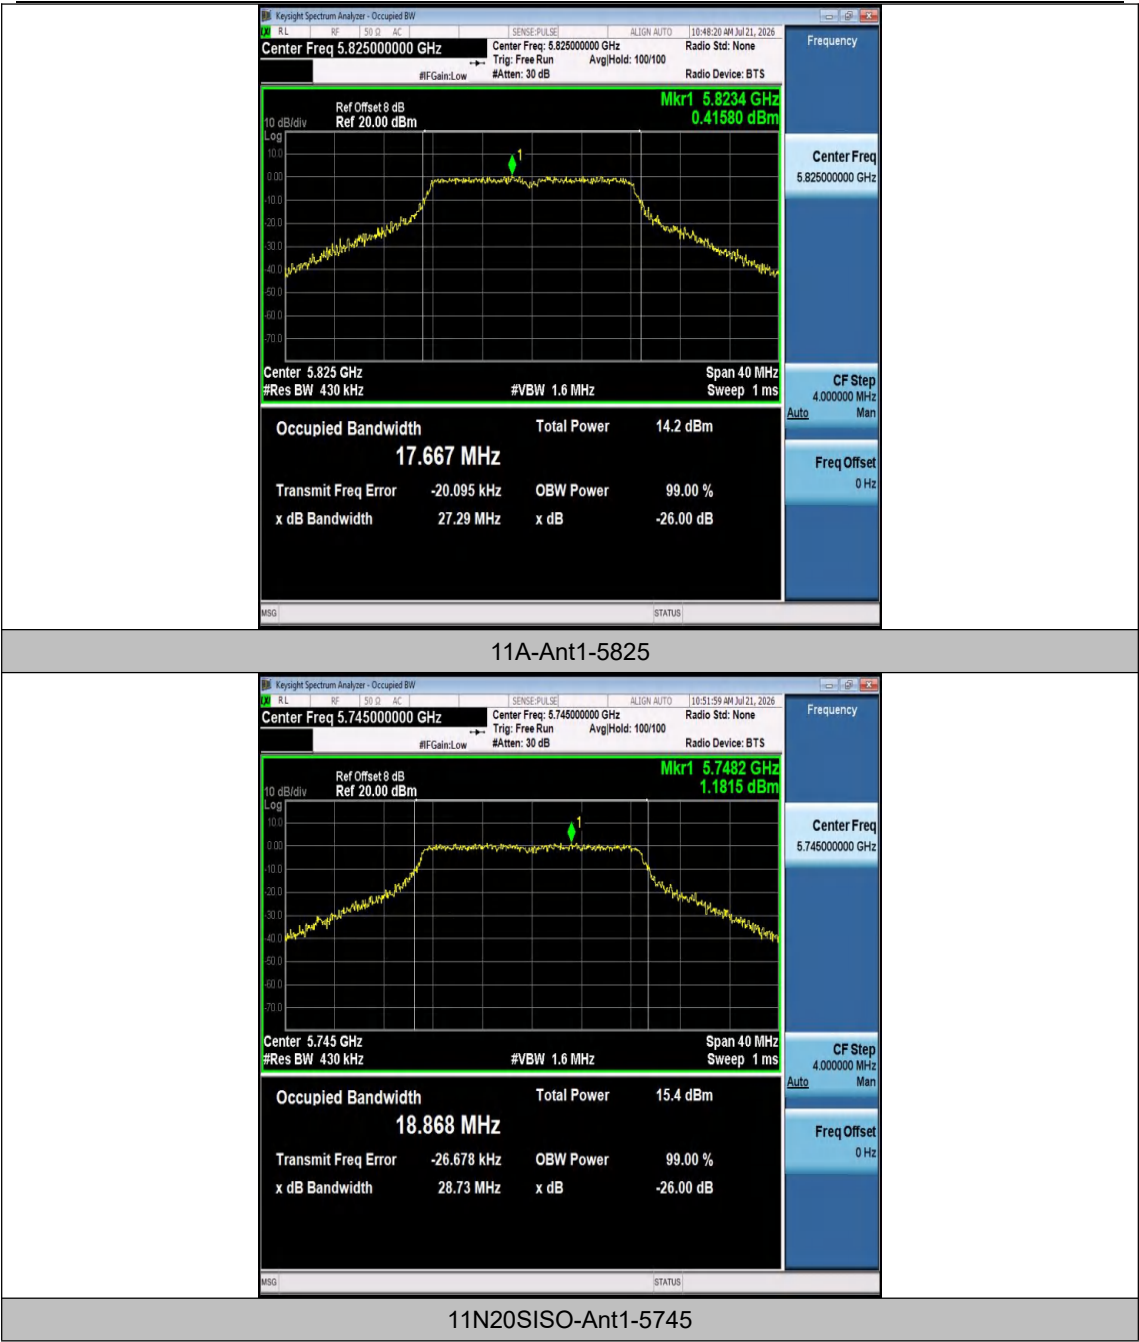




Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

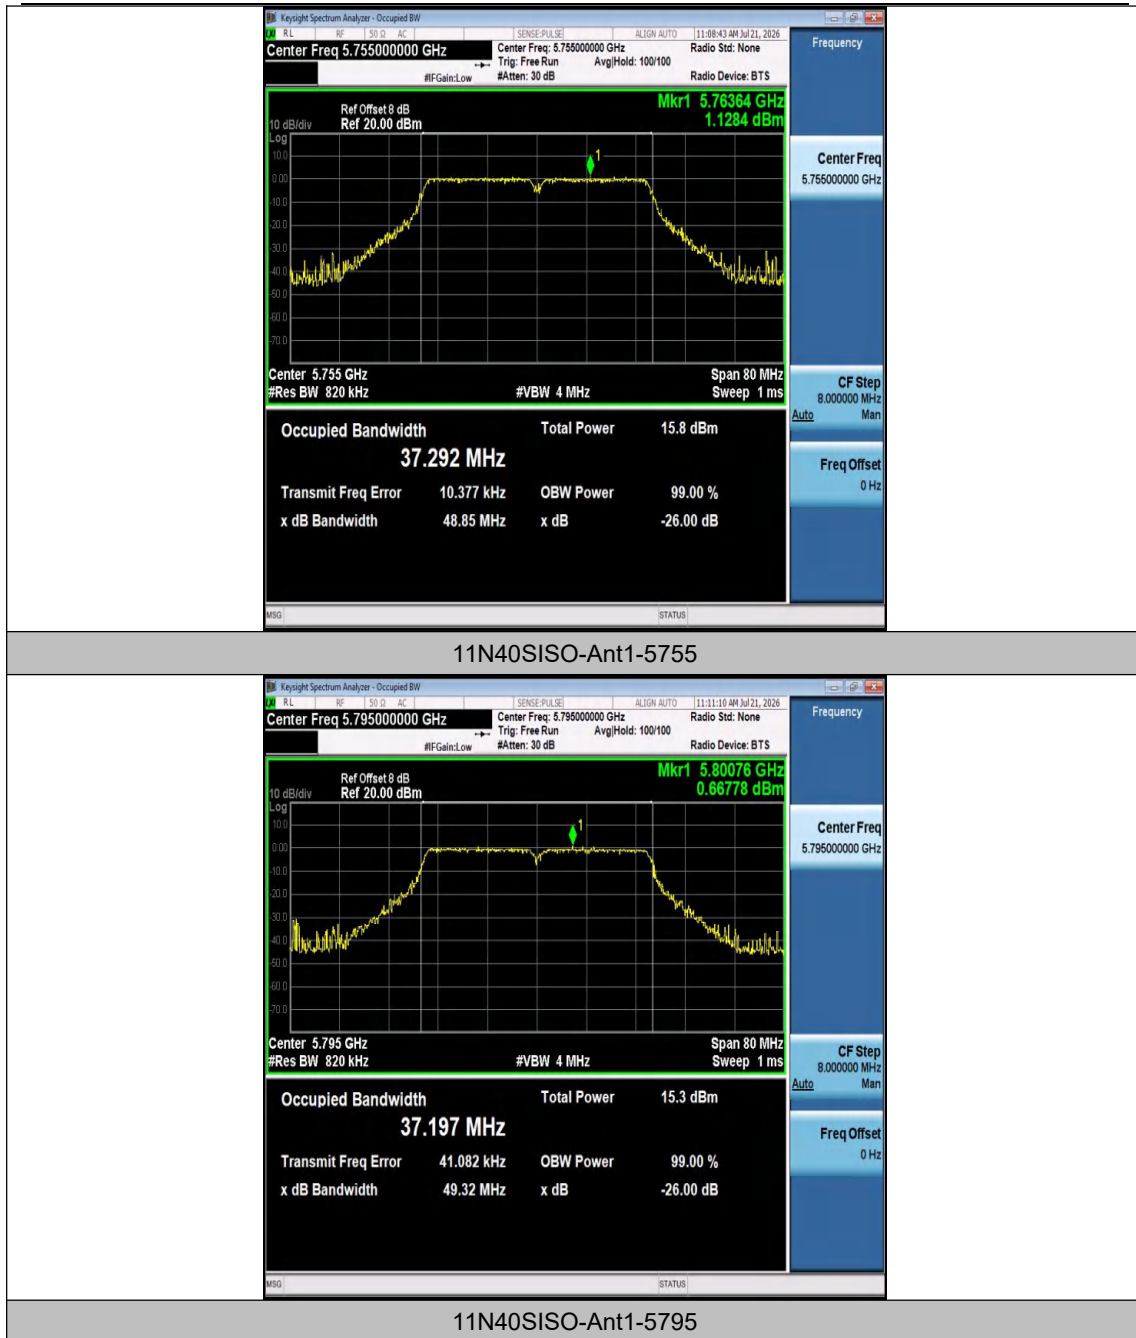

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

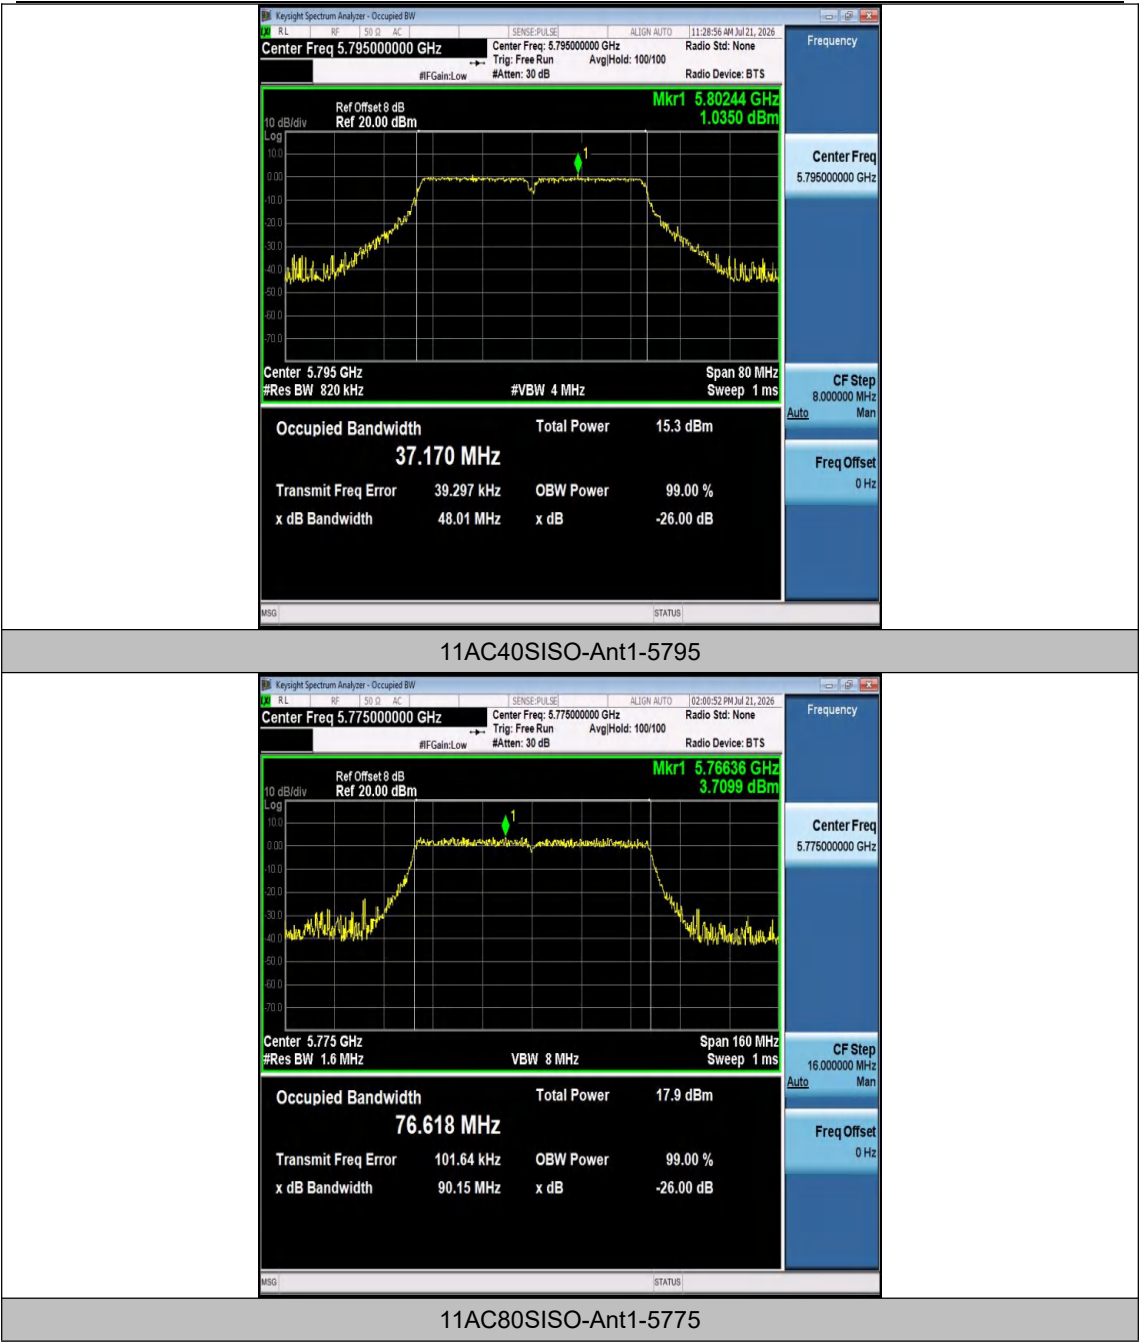


Appendix A3: Minimum 6dB Bandwidth

Test Result B4

Test Mode	Antenna	Frequency[MHz]	6db EBW [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5745	16.360	5736.800	5753.160	0.5	PASS
11A	Ant1	5785	16.400	5776.760	5793.160	0.5	PASS
11A	Ant1	5825	16.400	5816.760	5833.160	0.5	PASS
11N20SISO	Ant1	5745	17.640	5736.160	5753.800	0.5	PASS
11N20SISO	Ant1	5785	17.600	5776.160	5793.760	0.5	PASS
11N20SISO	Ant1	5825	17.600	5816.200	5833.800	0.5	PASS
11N40SISO	Ant1	5755	36.400	5736.760	5773.160	0.5	PASS
11N40SISO	Ant1	5795	36.320	5776.840	5813.160	0.5	PASS
11AC20SISO	Ant1	5745	17.600	5736.200	5753.800	0.5	PASS
11AC20SISO	Ant1	5785	17.600	5776.200	5793.800	0.5	PASS
11AC20SISO	Ant1	5825	17.680	5816.120	5833.800	0.5	PASS
11AC40SISO	Ant1	5755	36.320	5736.840	5773.160	0.5	PASS
11AC40SISO	Ant1	5795	36.320	5776.840	5813.160	0.5	PASS
11AC80SISO	Ant1	5775	76.160	5736.760	5812.920	0.5	PASS

Test Graphs B4

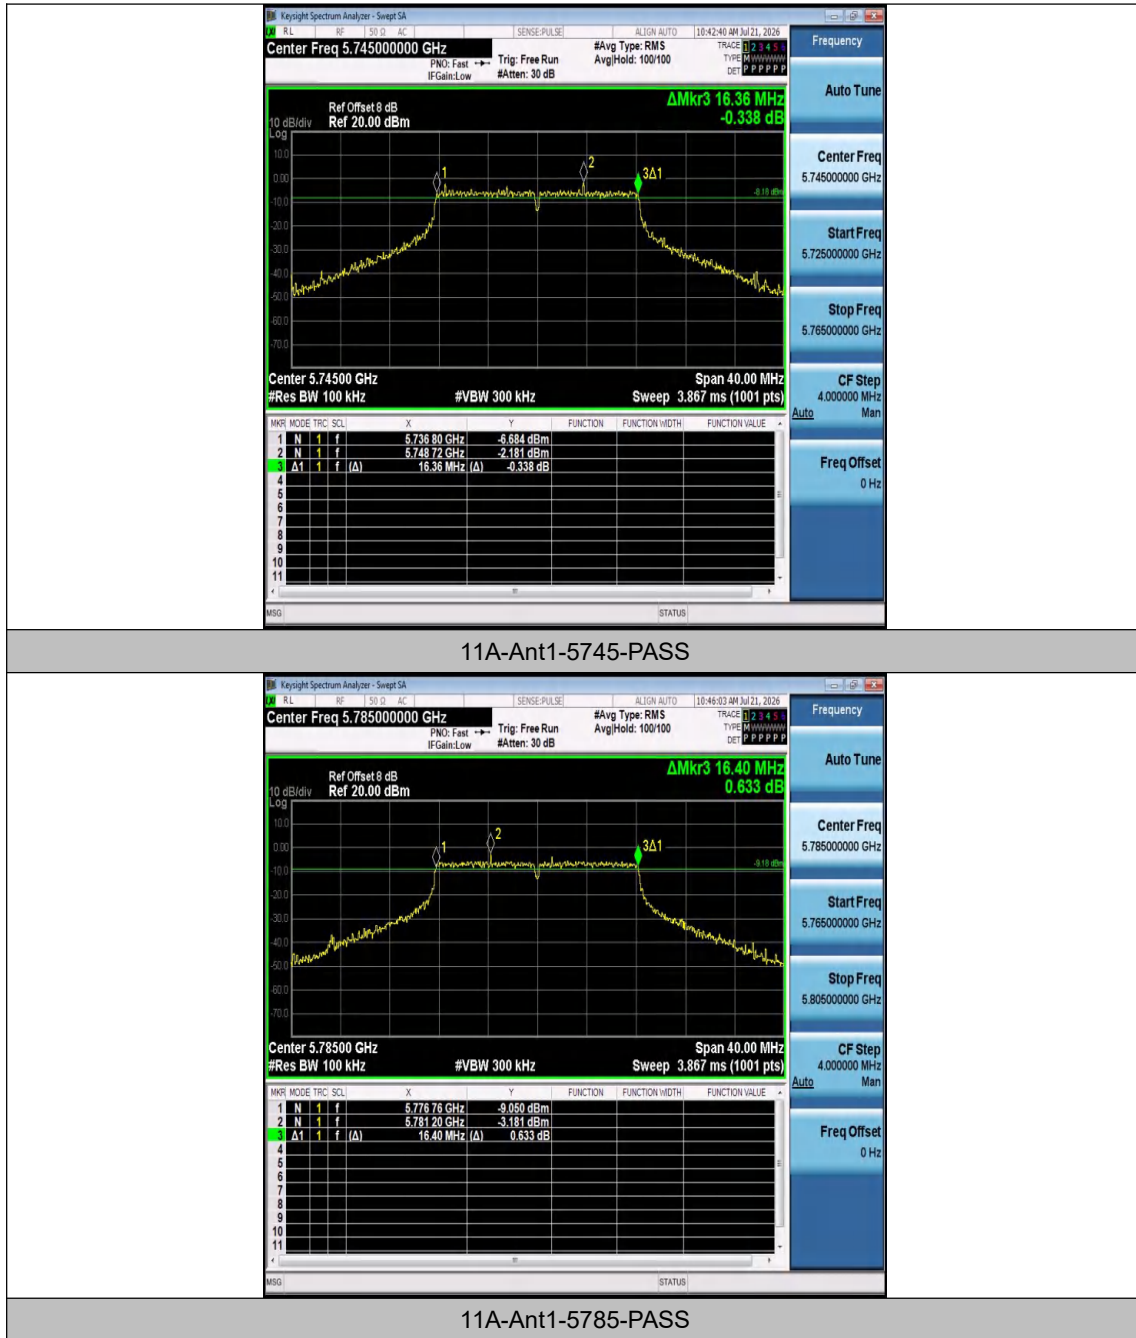

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

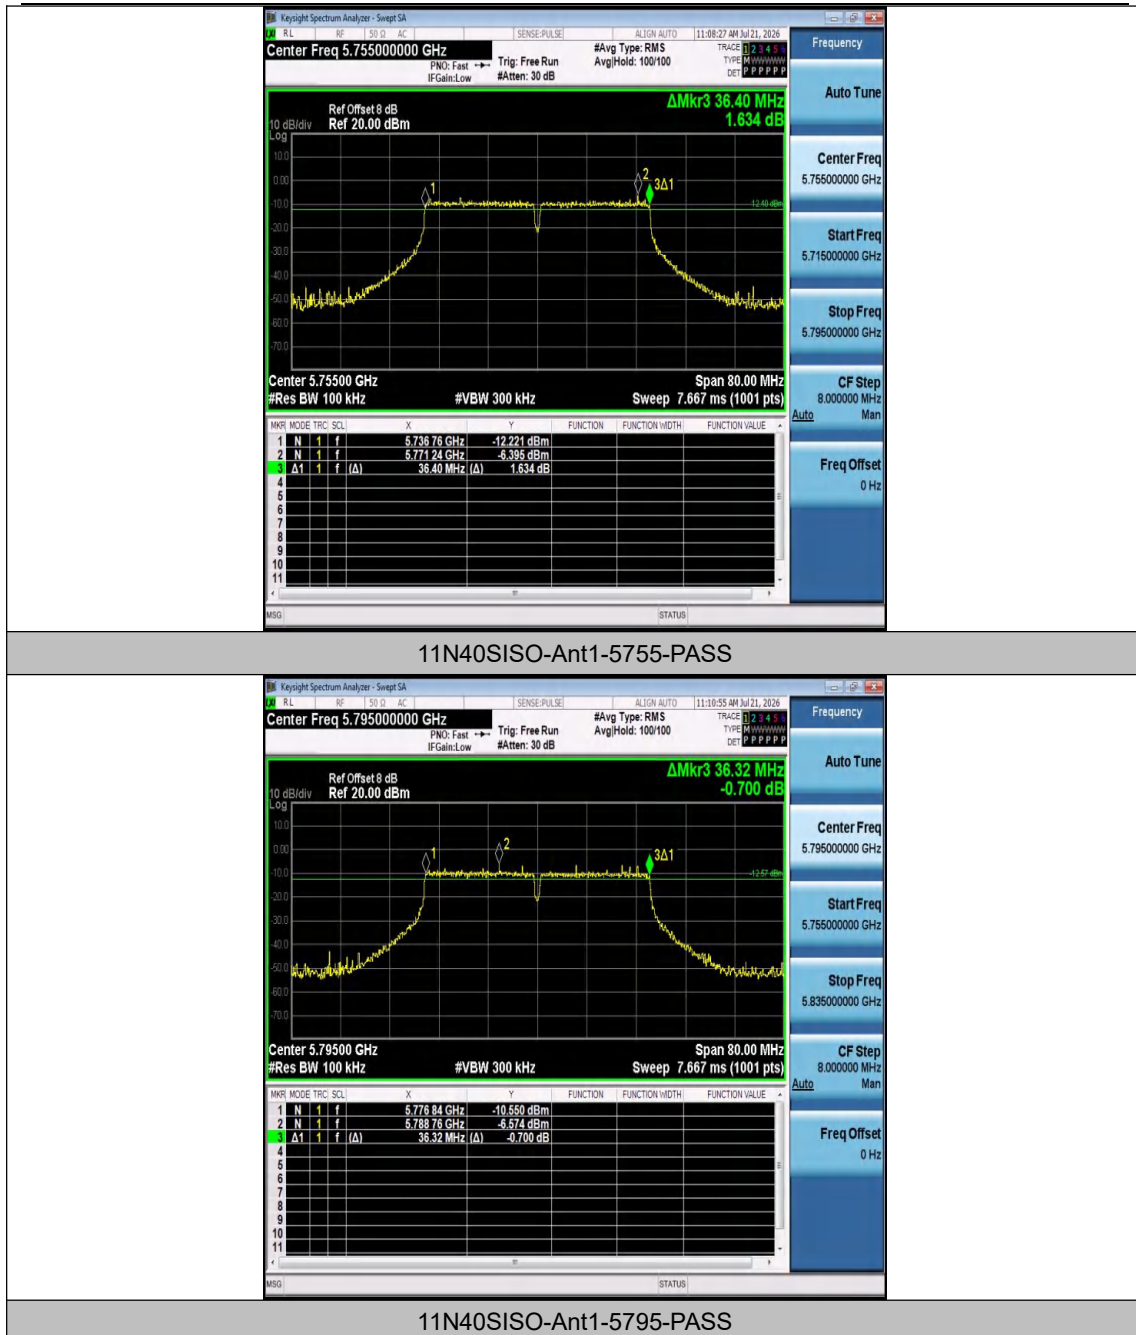



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

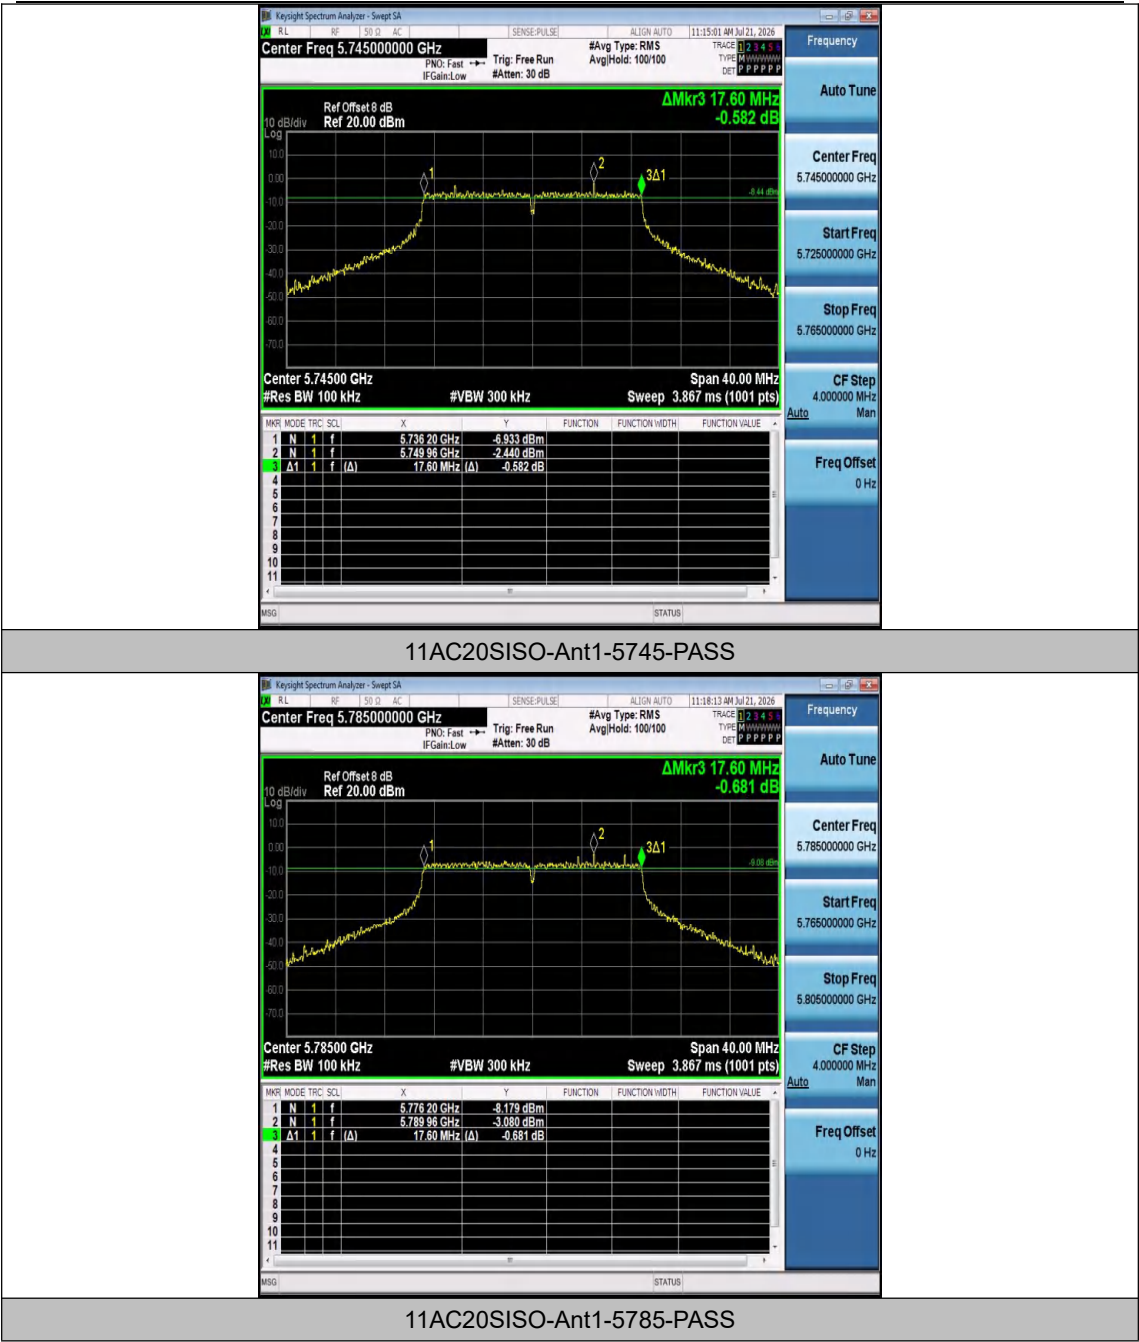

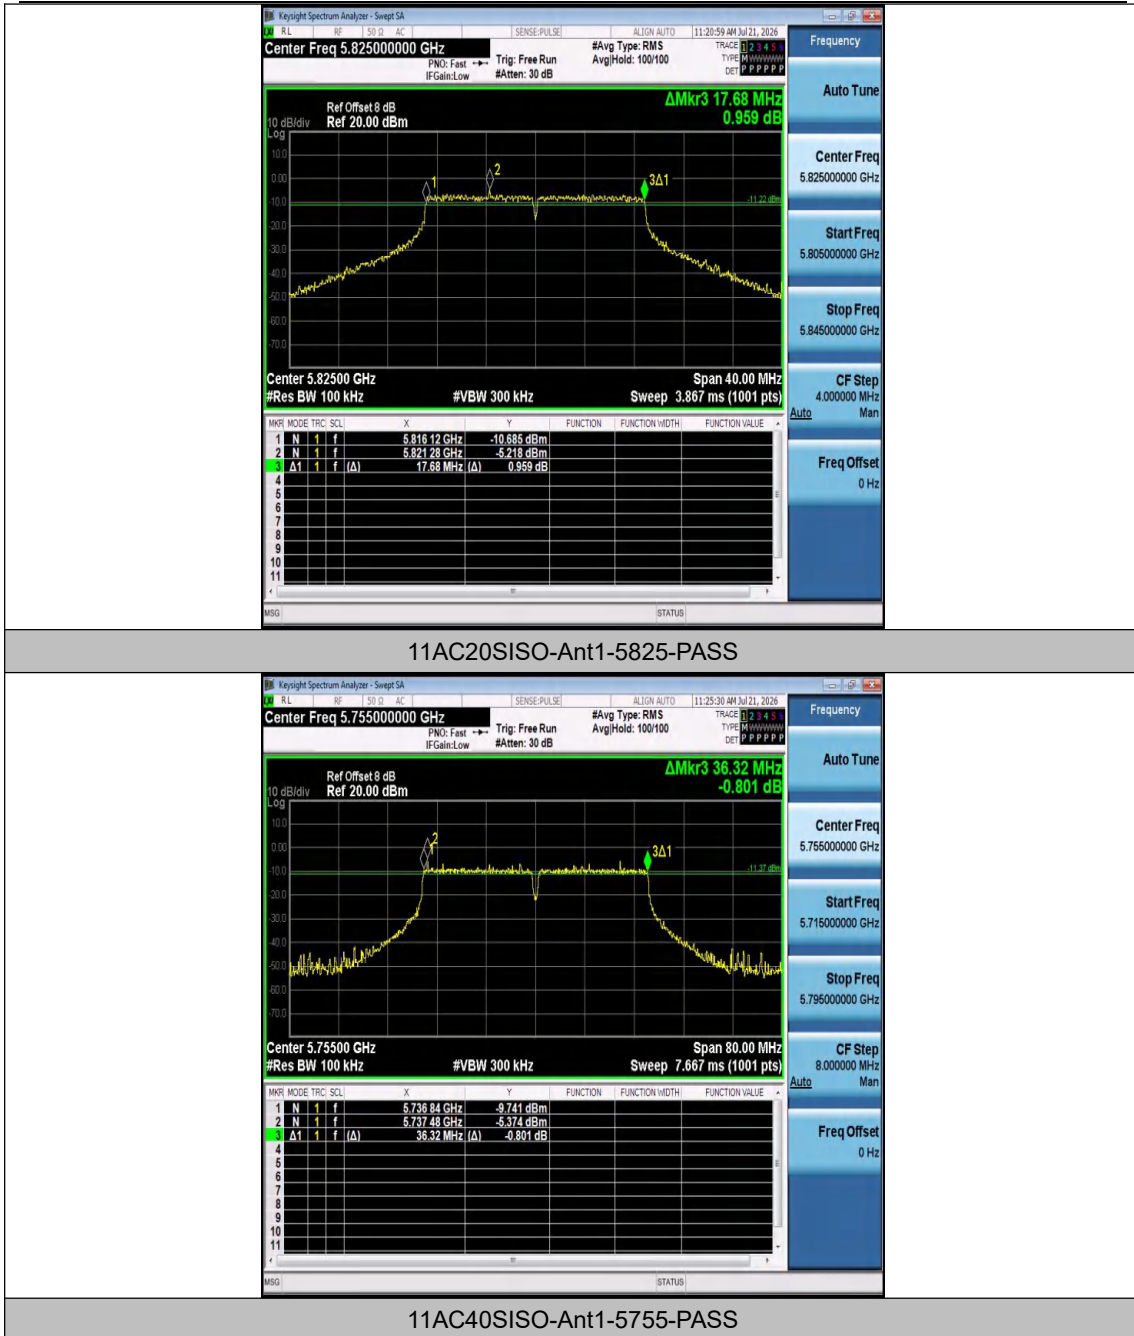

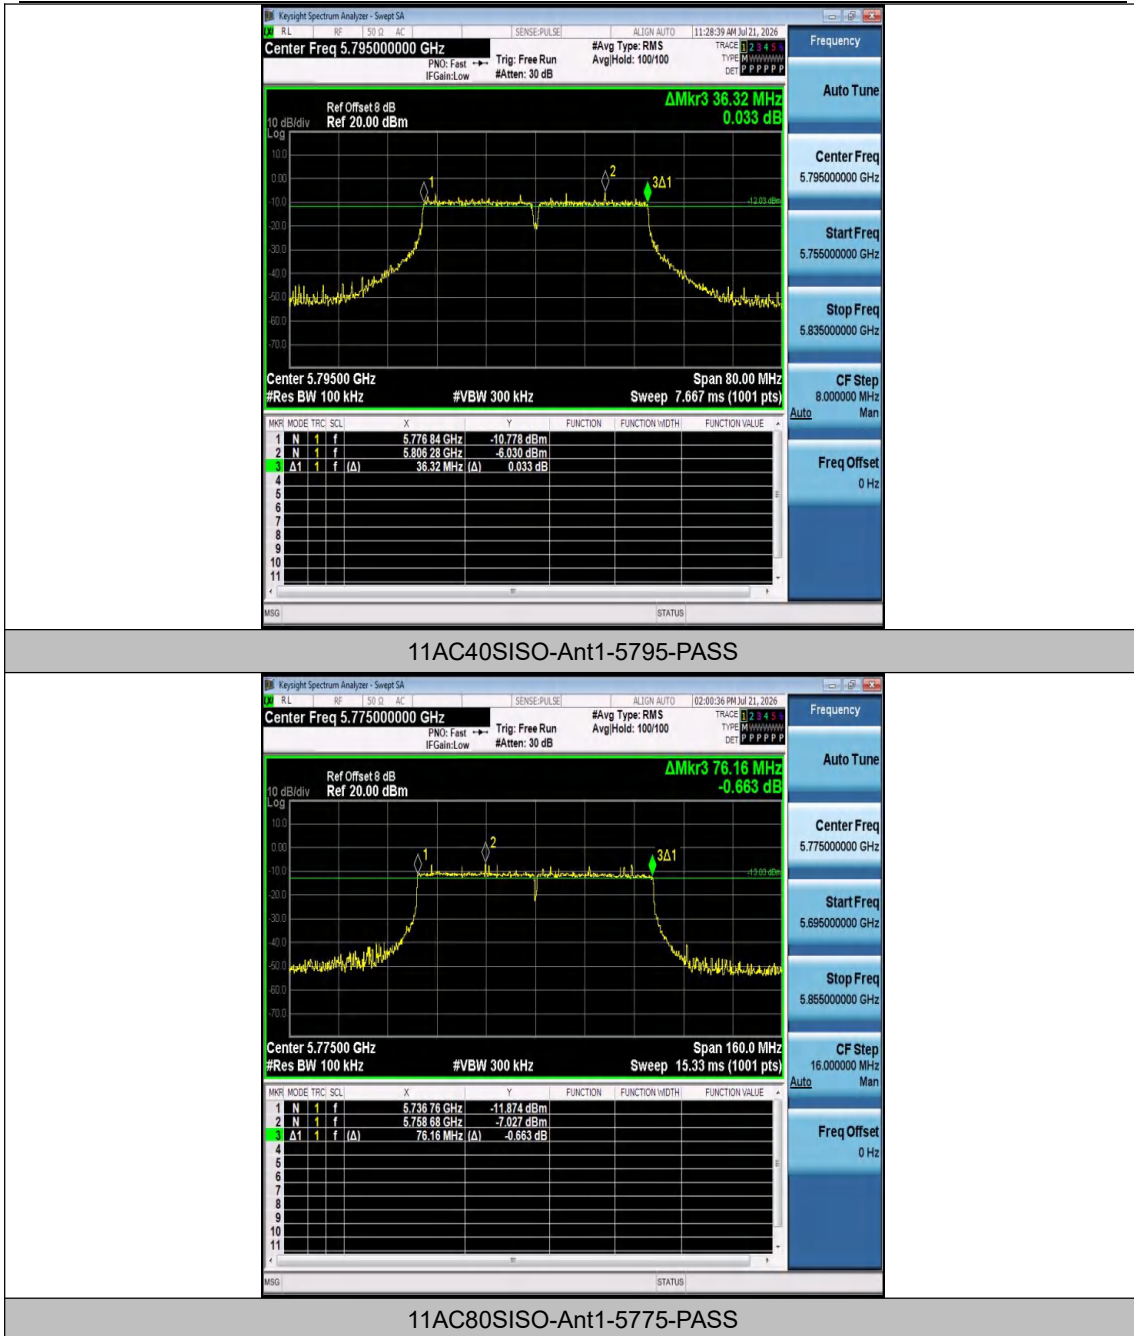

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix B: Duty Cycle

Test Result

Test Mode	Antenna	Frequency[MHz]	Transmission Duration [ms]	Transmission Period [ms]	Duty Cycle [%]	Dc Factor [dB]	1/T
11A	Ant1	5745	5.36	5.54	96.75	0.14	0.19
11A	Ant1	5785	5.36	5.60	95.71	0.19	0.19
11A	Ant1	5825	5.37	5.56	96.58	0.15	0.19
11N20SISO	Ant1	5745	4.97	5.09	97.64	0.10	0.20
11N20SISO	Ant1	5785	4.97	5.15	96.50	0.15	0.20
11N20SISO	Ant1	5825	4.97	5.20	95.58	0.20	0.20
11N40SISO	Ant1	5755	4.79	4.97	96.38	0.16	0.21
11N40SISO	Ant1	5795	4.79	5.02	95.42	0.20	0.21
11AC20SISO	Ant1	5745	4.98	5.20	95.77	0.19	0.20
11AC20SISO	Ant1	5785	4.97	5.21	95.39	0.20	0.20
11AC20SISO	Ant1	5825	4.98	5.22	95.40	0.20	0.20
11AC40SISO	Ant1	5755	4.79	5.01	95.61	0.19	0.21
11AC40SISO	Ant1	5795	4.79	5.01	95.61	0.19	0.21
11AC80SISO	Ant1	5775	4.42	4.66	94.85	0.23	0.23


Test Graphs

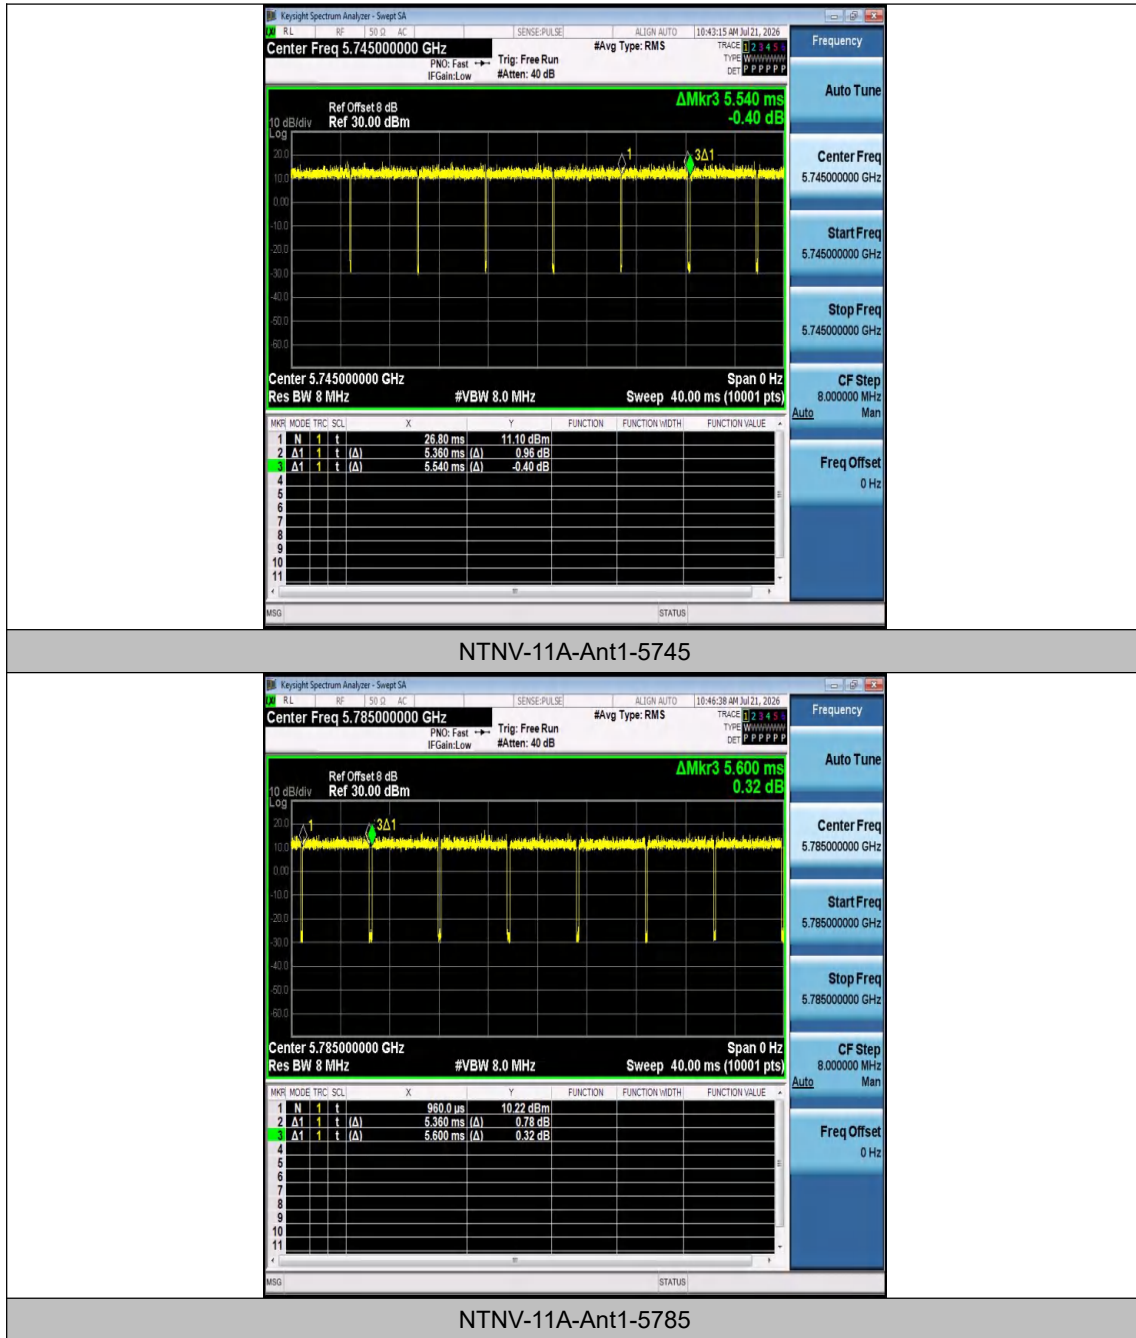



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

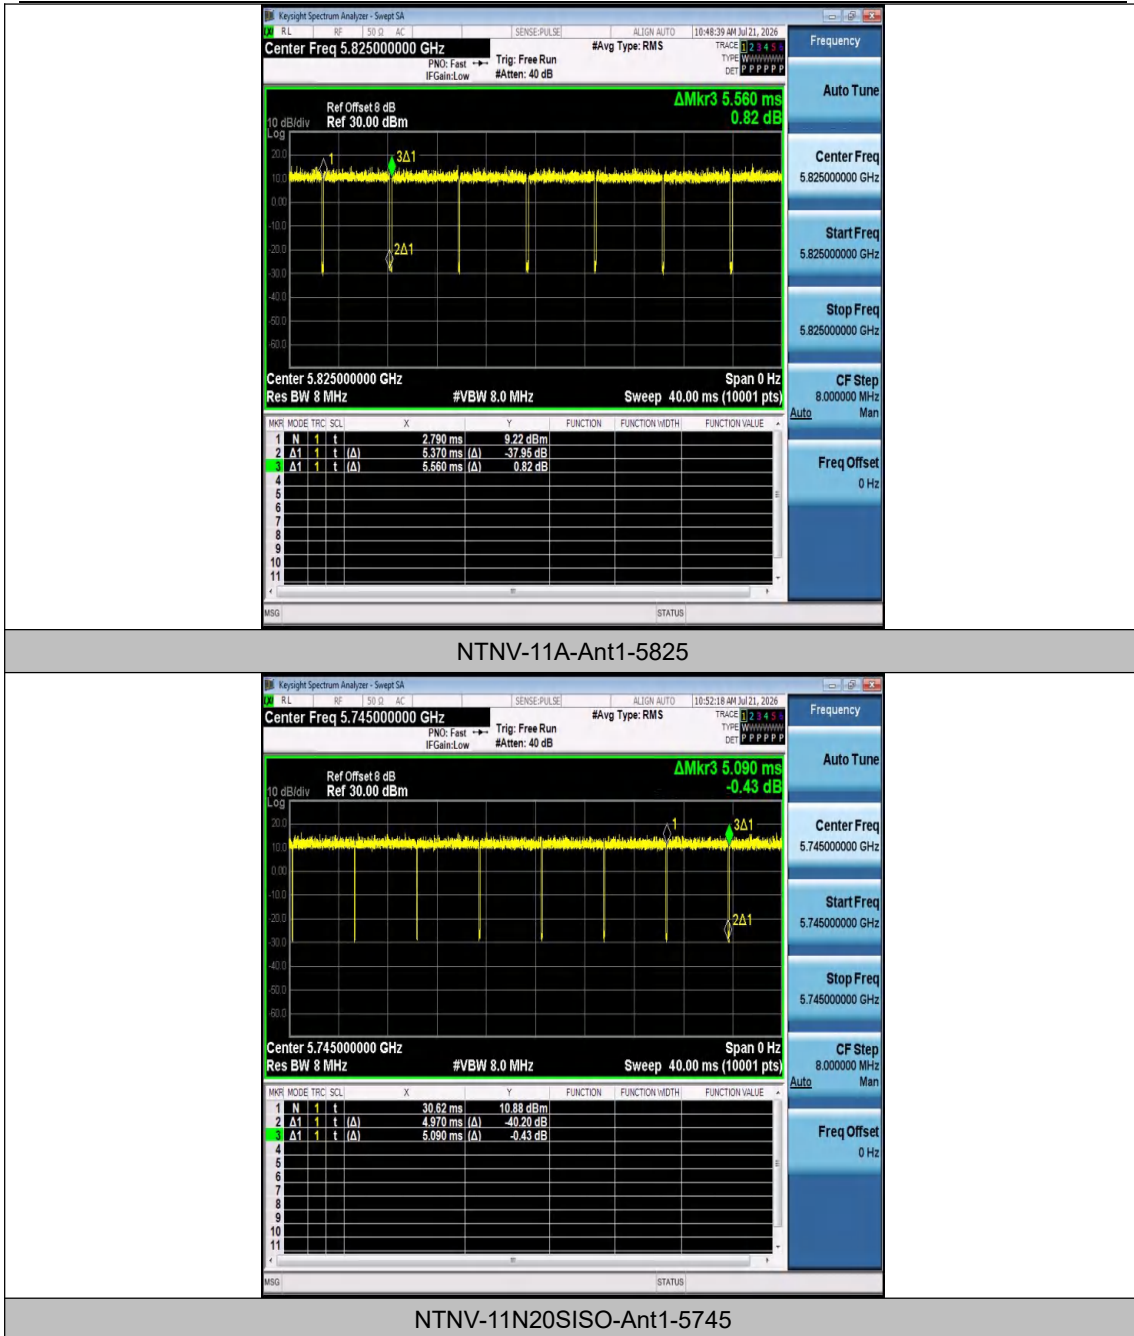

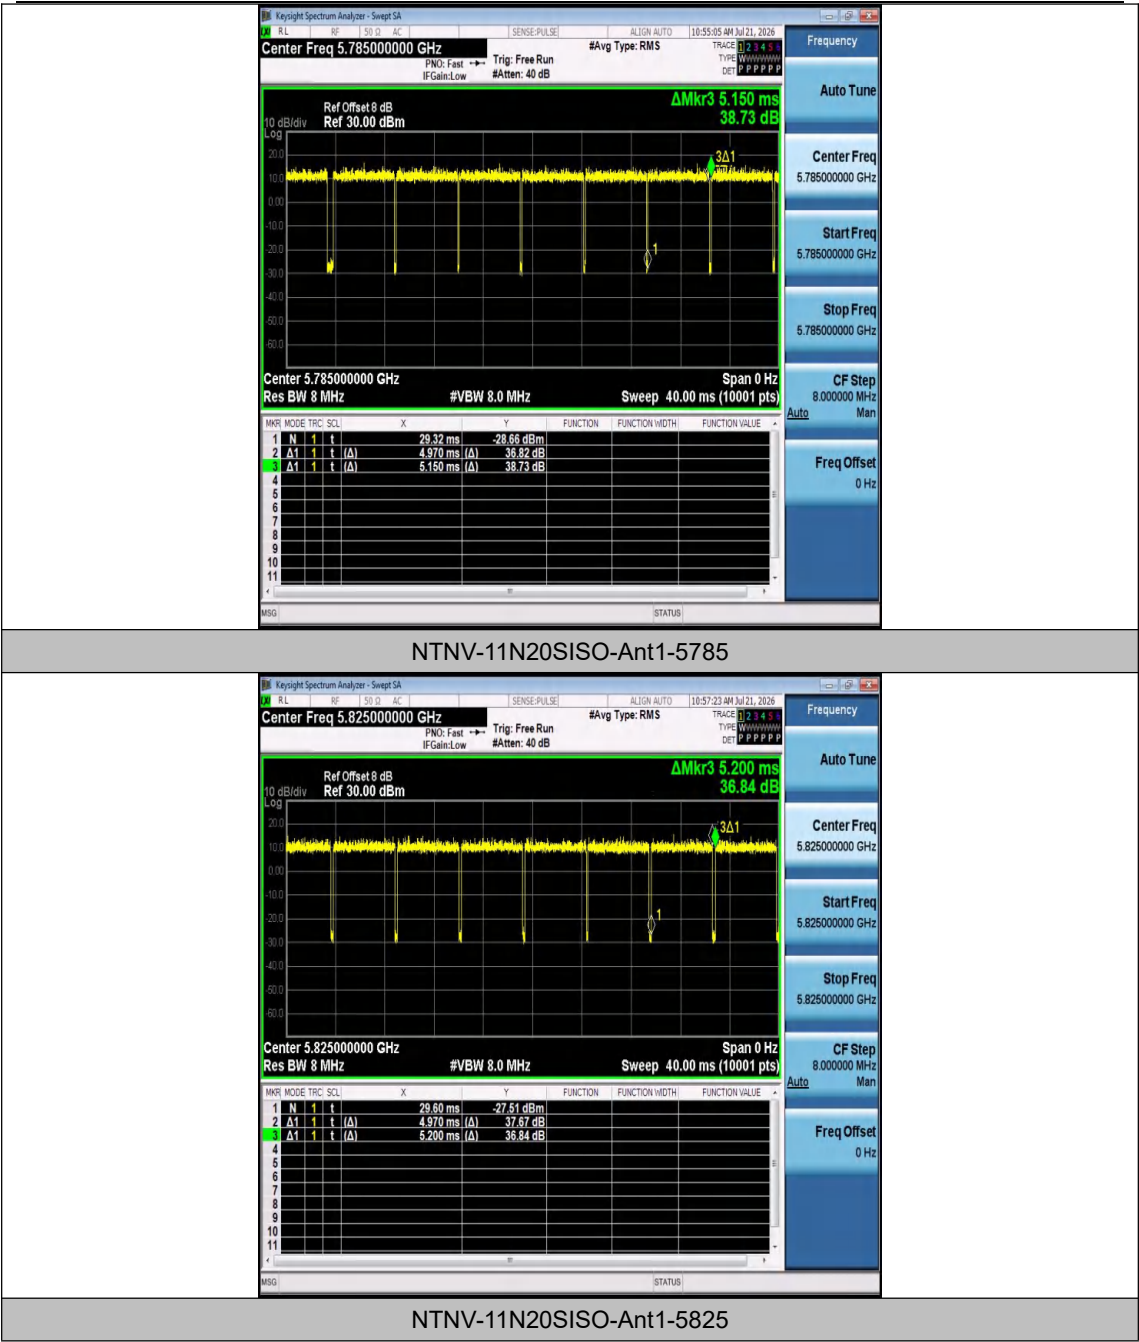


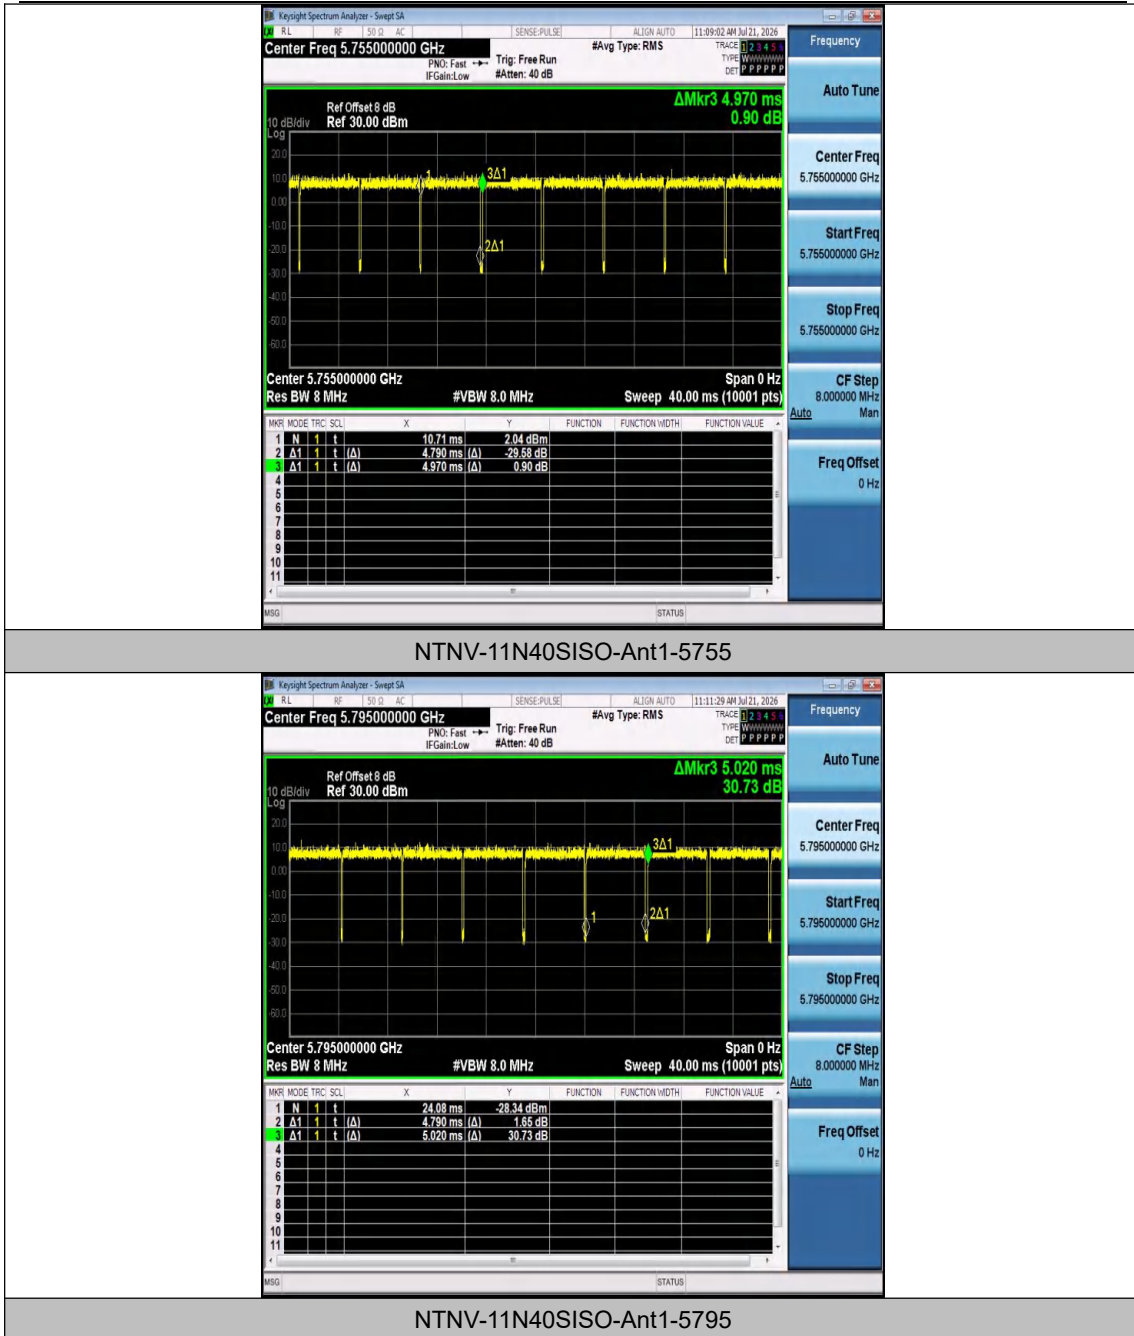



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

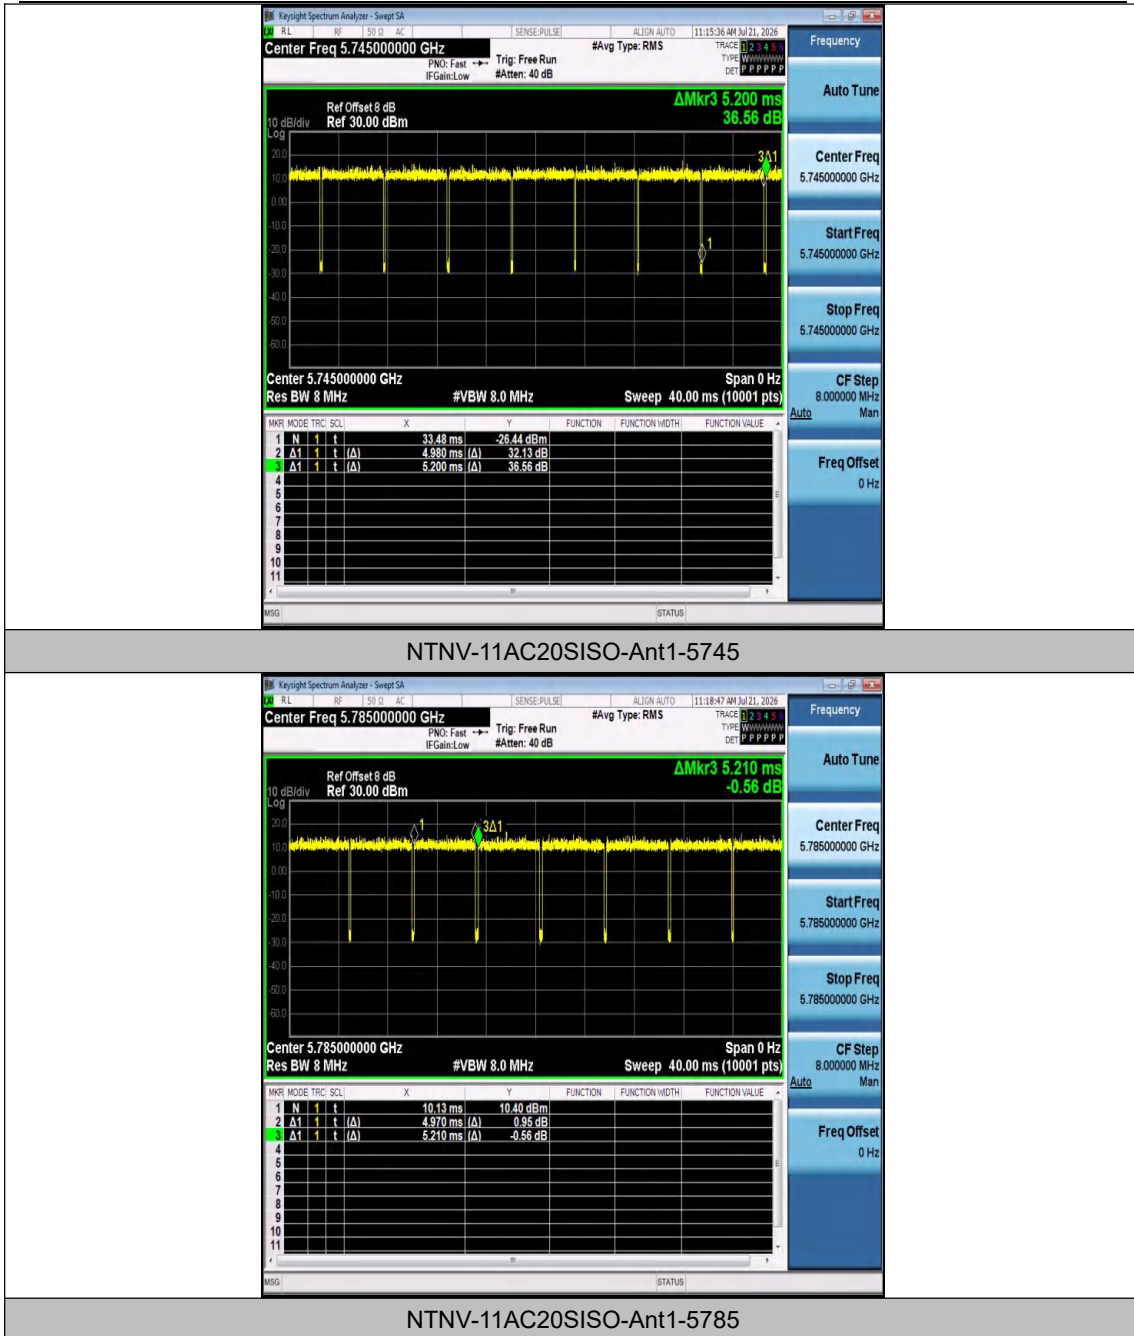

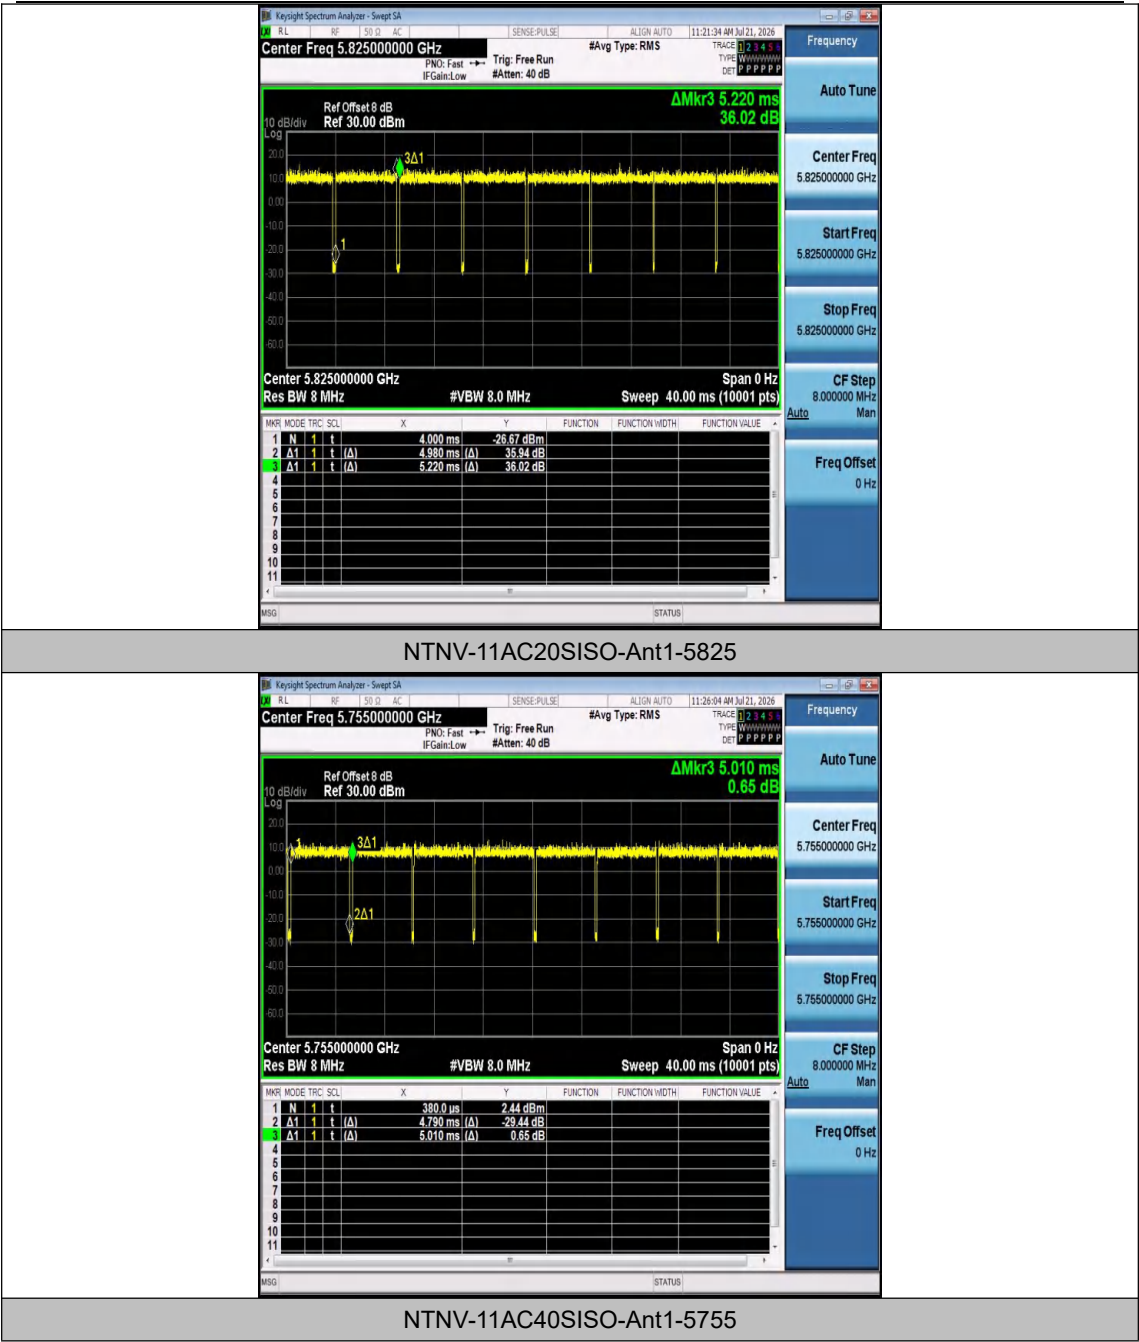

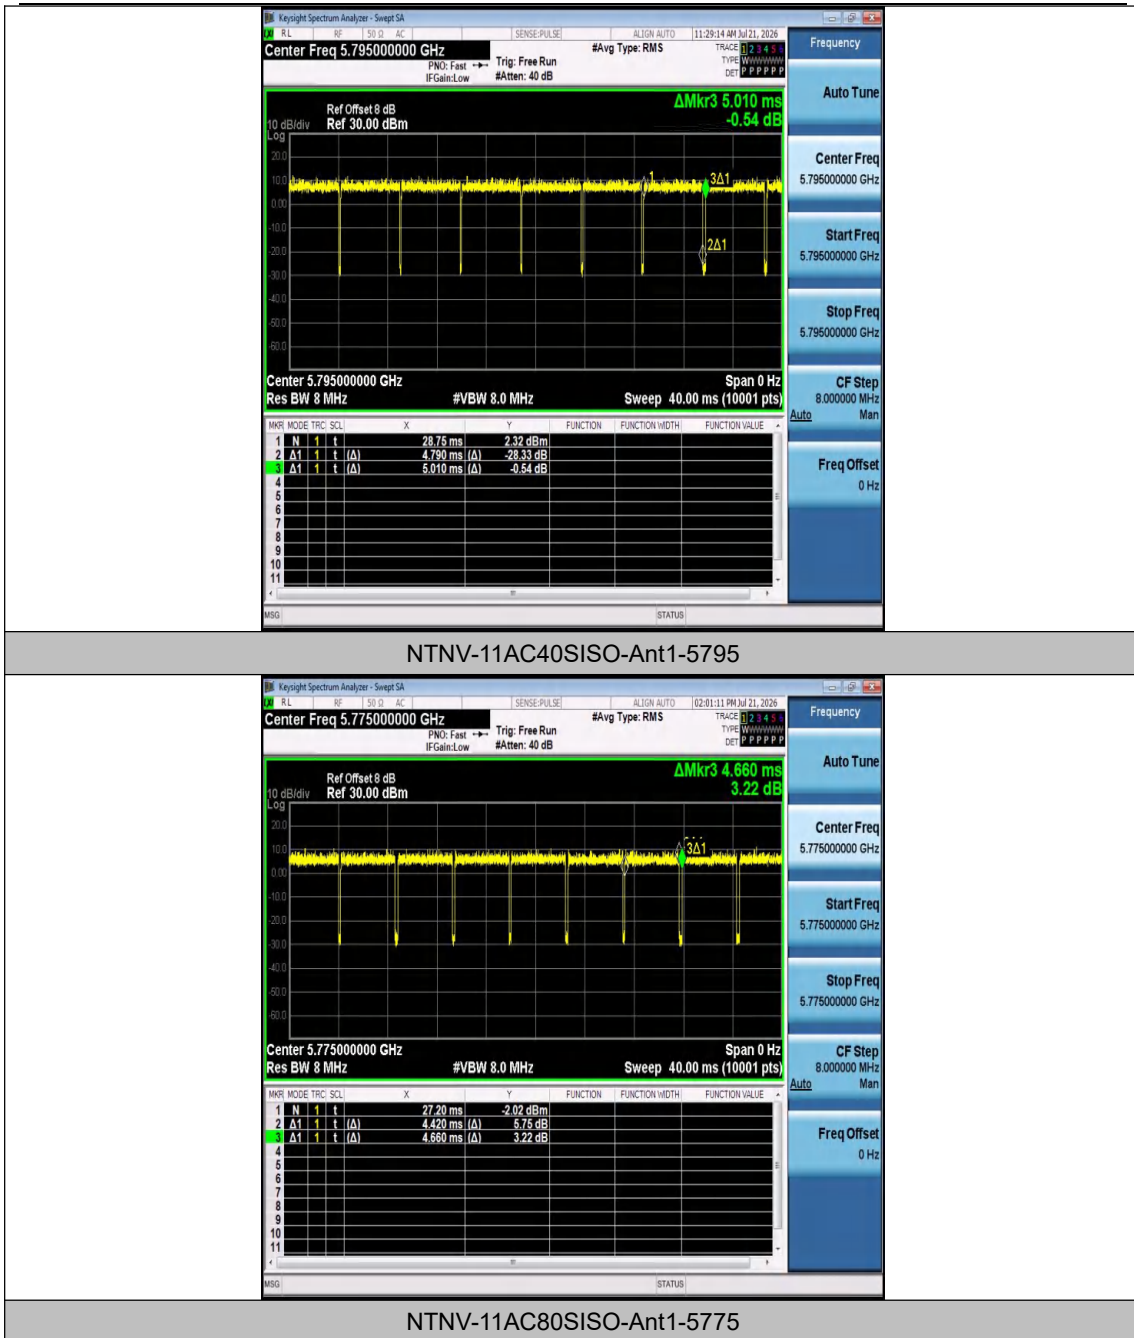


Appendix C: Maximum Conducted Output Power

Test Result Channel Power

Test Mode	Antenna	Frequency [MHz]	Set Power	Channel Power [dBm]	Duty Cycle [%]	DC Factor [dB]	Result [dBm]	Limit [dBm]	Verdict
11A	Ant1	5745	---	14.36	96.75	0.14	14.50	≤30.00	PASS
11A	Ant1	5785	---	13.68	95.71	0.19	13.87	≤30.00	PASS
11A	Ant1	5825	---	12.99	96.58	0.15	13.14	≤30.00	PASS
11N20SISO	Ant1	5745	---	14.16	97.64	0.10	14.26	≤30.00	PASS
11N20SISO	Ant1	5785	---	13.60	96.50	0.15	13.75	≤30.00	PASS
11N20SISO	Ant1	5825	---	12.85	95.58	0.20	13.05	≤30.00	PASS
11N40SISO	Ant1	5755	---	13.50	96.38	0.16	13.66	≤30.00	PASS
11N40SISO	Ant1	5795	---	12.93	95.42	0.20	13.13	≤30.00	PASS
11AC20SISO	Ant1	5745	---	14.04	95.77	0.19	14.23	≤30.00	PASS
11AC20SISO	Ant1	5785	---	13.60	95.39	0.20	13.80	≤30.00	PASS
11AC20SISO	Ant1	5825	---	12.88	95.40	0.20	13.08	≤30.00	PASS
11AC40SISO	Ant1	5755	---	13.52	95.61	0.19	13.71	≤30.00	PASS
11AC40SISO	Ant1	5795	---	12.99	95.61	0.19	13.18	≤30.00	PASS
11AC80SISO	Ant1	5775	---	14.45	94.85	0.23	14.68	≤30.00	PASS

Note: 1.The Duty Cycle Factor and cable loss are compensated in the graph.

Test Graphs Channel Power

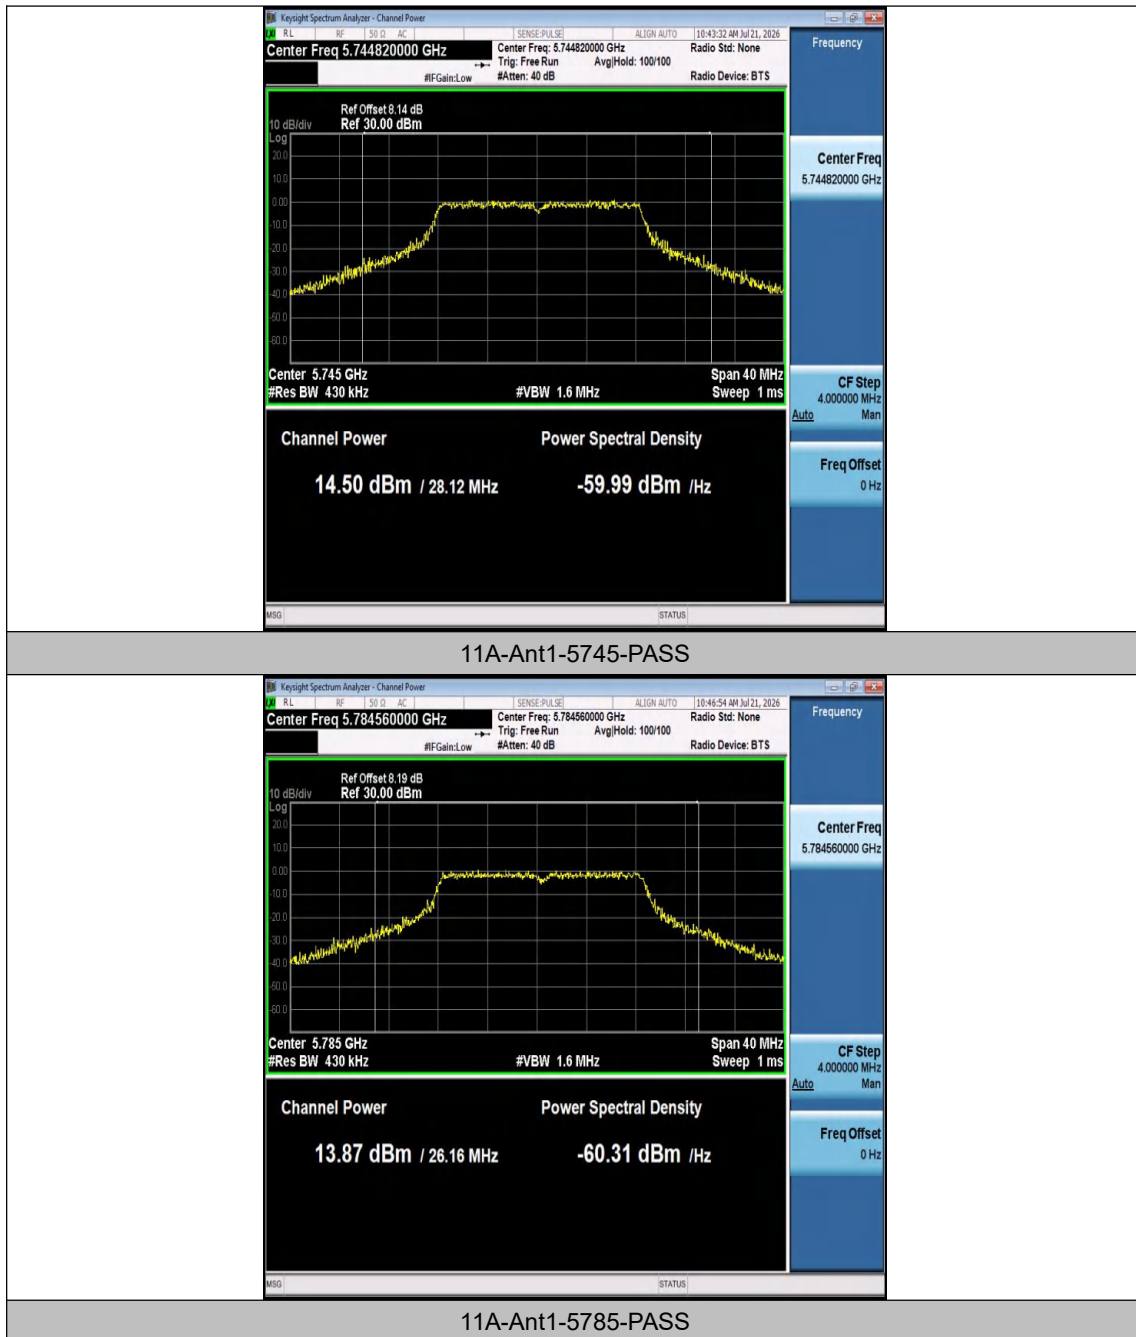



Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



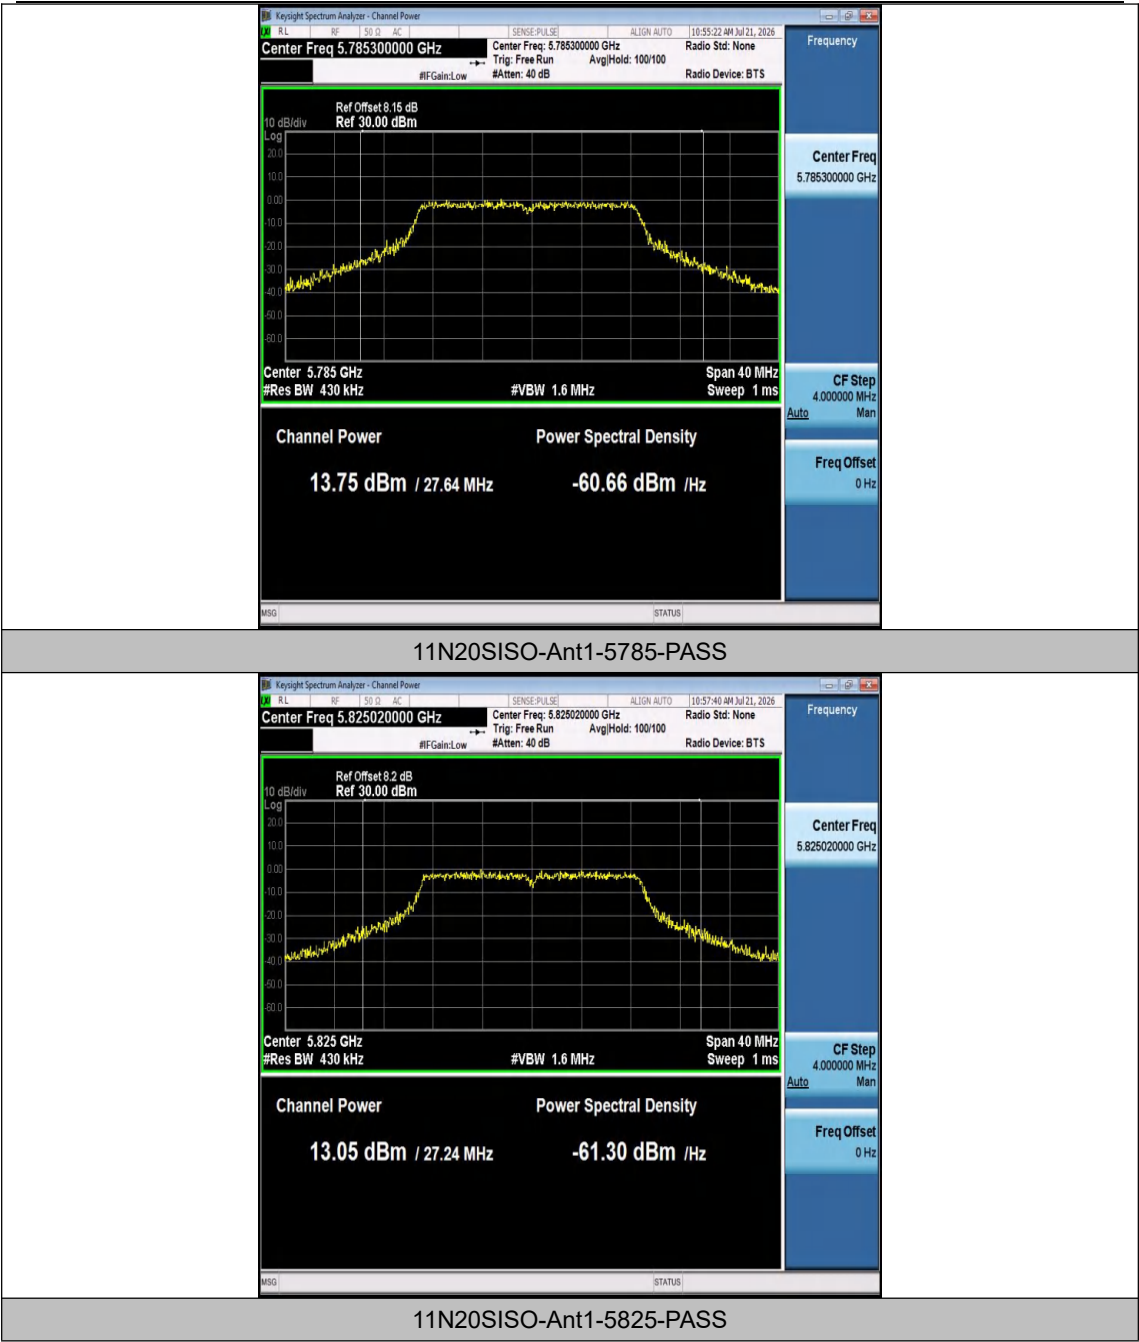

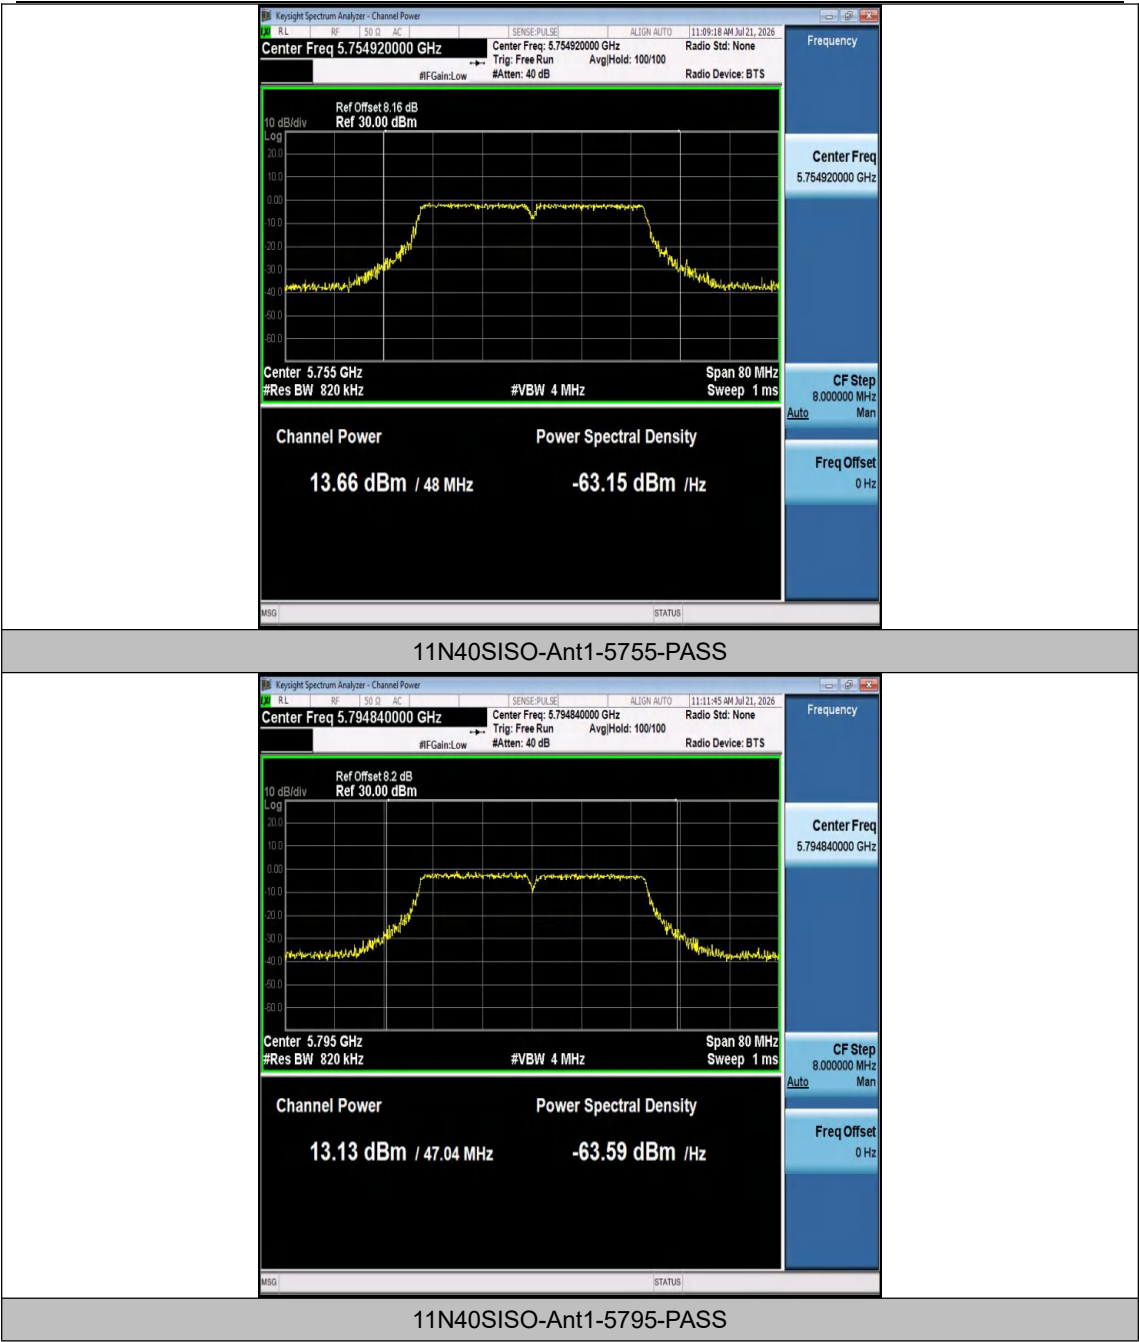

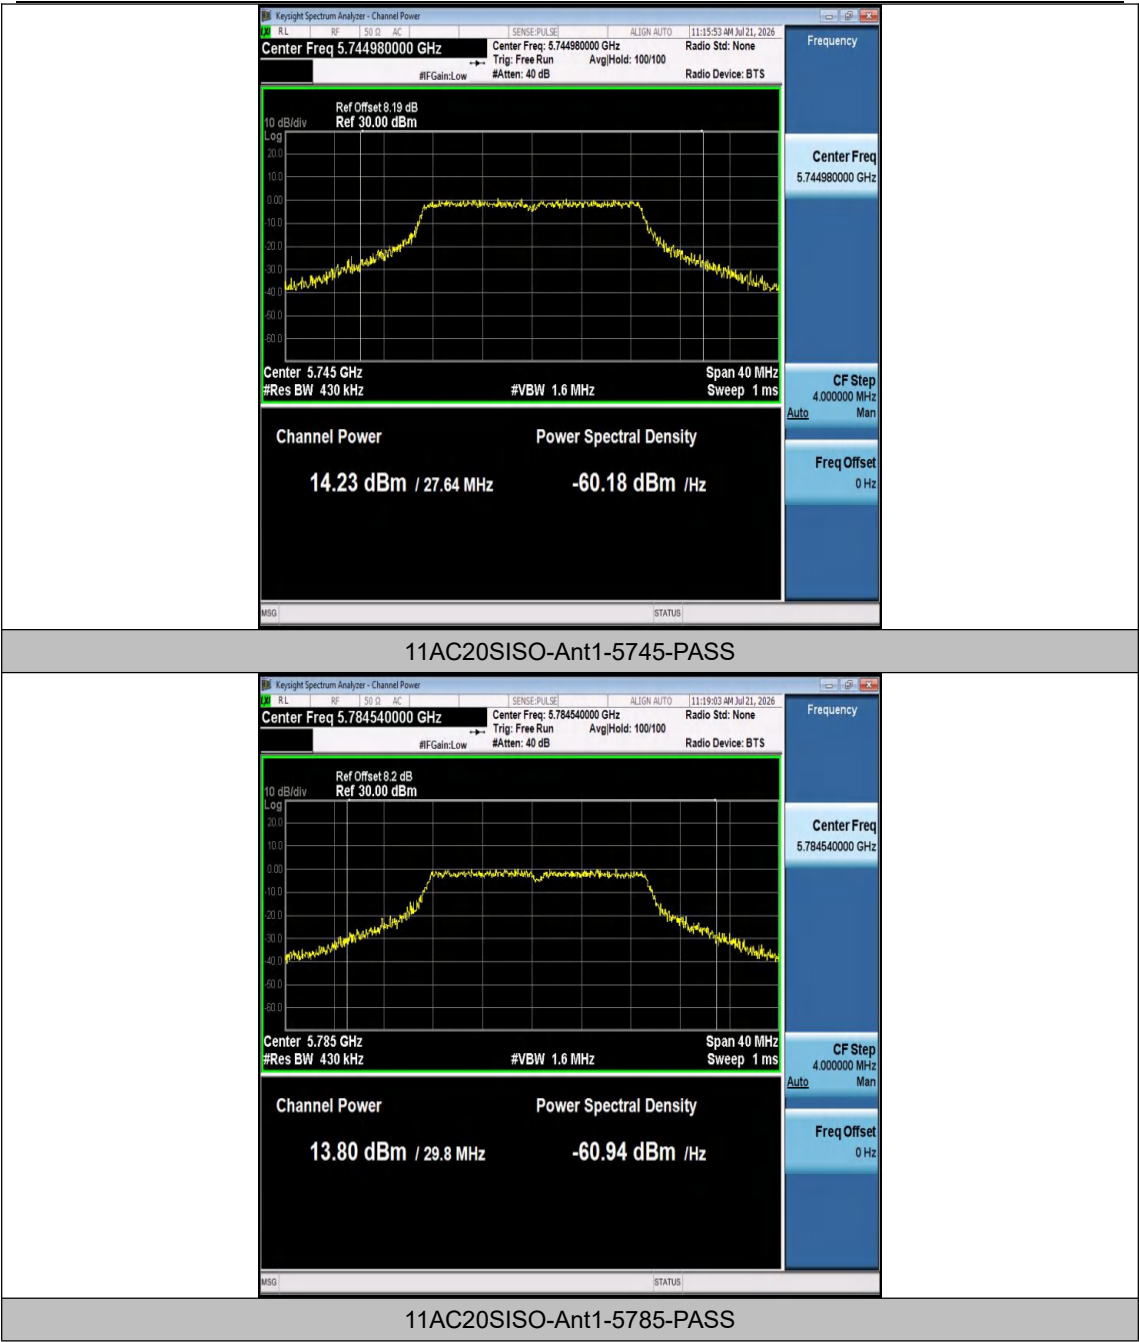


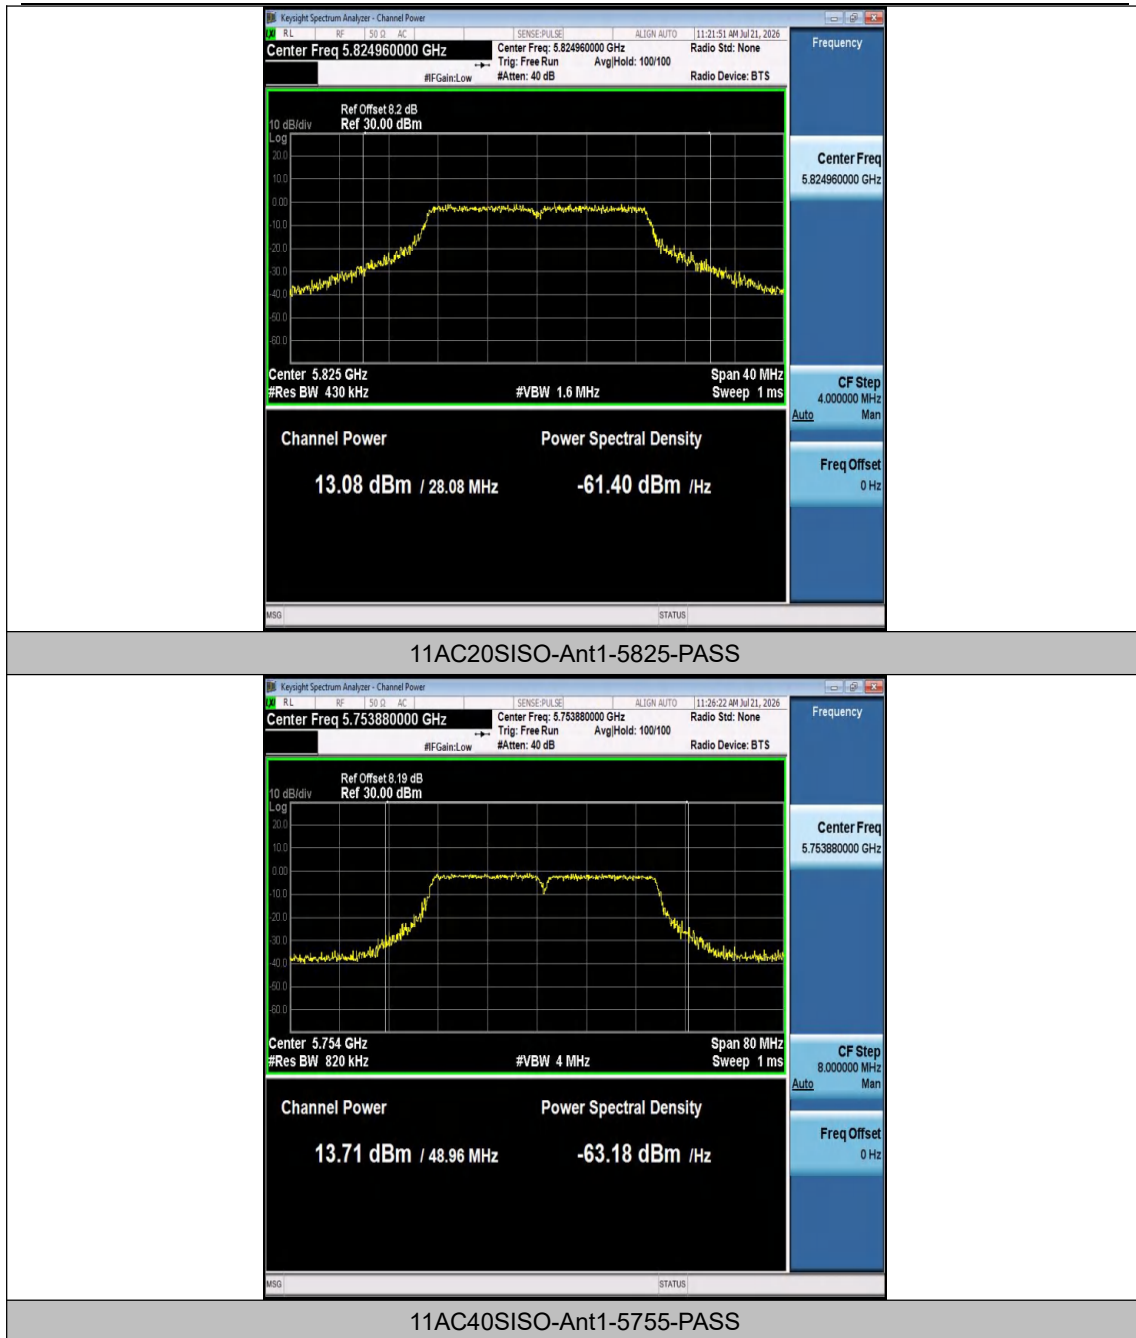

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

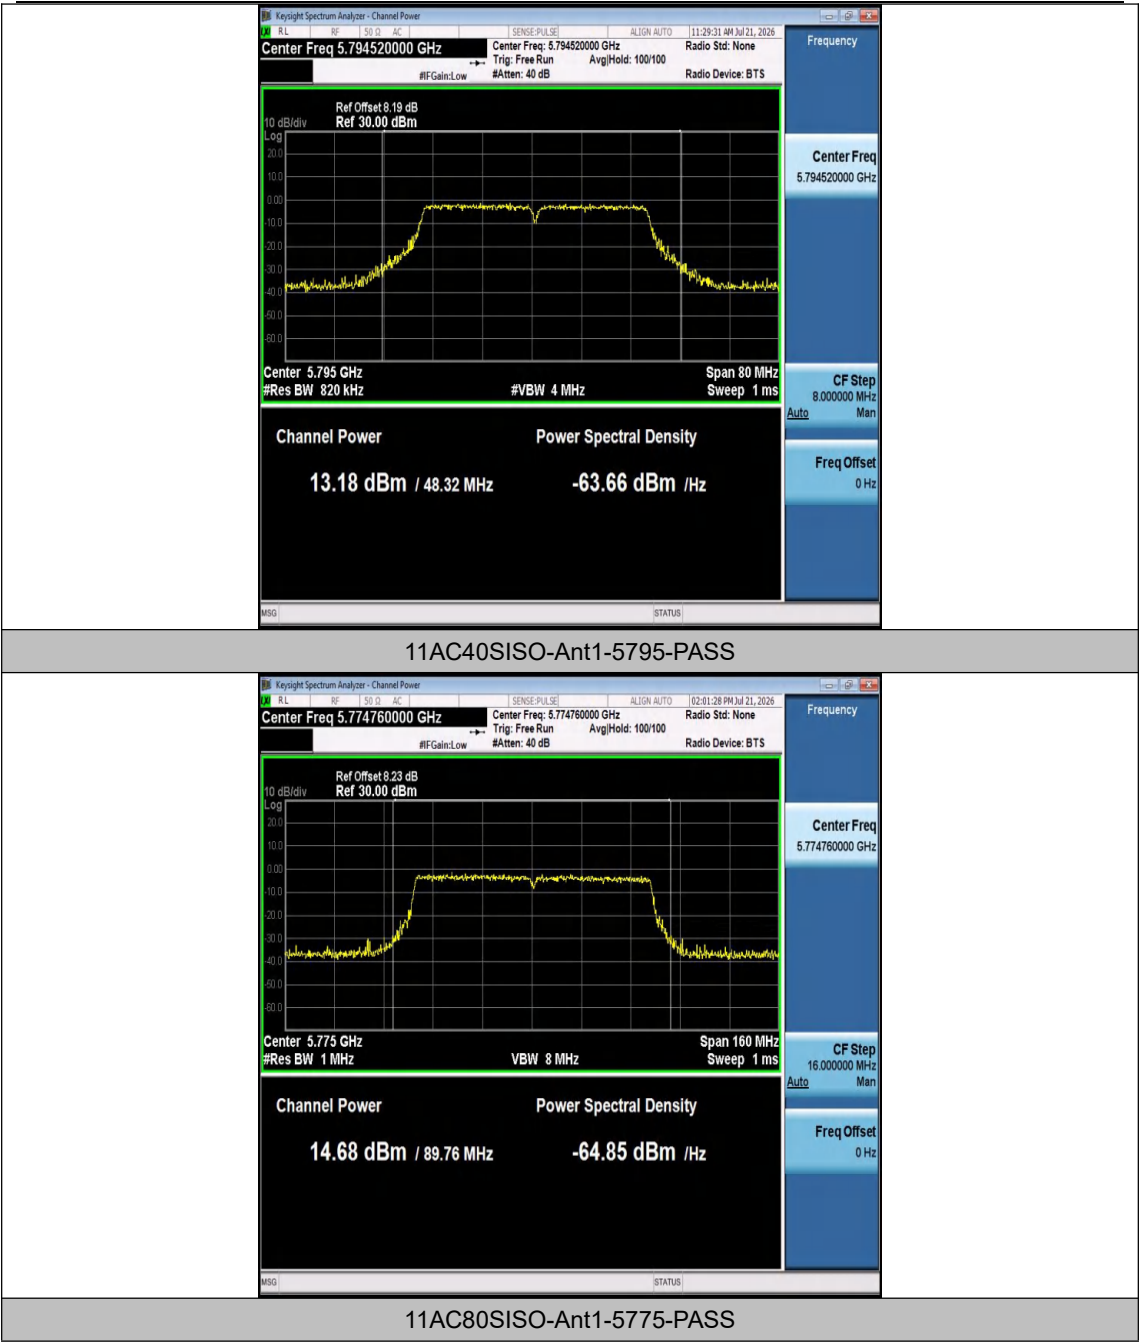

Appendix D: Maximum Power Spectral Density


Test Result B4

Test Mode	Antenna	Frequency[MHz]	Reading Result[dBm /300KHz]	RB Factor [dBm]	Result [dBm/500KHz]	Limit [dBm/500KHz]	Verdict
11A	Ant1	5745	-7.05	0.14	-4.69	≤30.00	PASS
11A	Ant1	5785	-7.70	0.19	-5.29	≤30.00	PASS
11A	Ant1	5825	-8.51	0.15	-6.14	≤30.00	PASS
11N20SISO	Ant1	5745	-7.55	0.10	-5.23	≤30.00	PASS
11N20SISO	Ant1	5785	-8.18	0.15	-5.81	≤30.00	PASS
11N20SISO	Ant1	5825	-8.98	0.20	-6.56	≤30.00	PASS
11N40SISO	Ant1	5755	-10.75	0.16	-8.37	≤30.00	PASS
11N40SISO	Ant1	5795	-11.37	0.20	-8.95	≤30.00	PASS
11AC20SISO	Ant1	5745	-7.65	0.19	-5.24	≤30.00	PASS
11AC20SISO	Ant1	5785	-8.22	0.20	-5.80	≤30.00	PASS
11AC20SISO	Ant1	5825	-8.84	0.20	-6.42	≤30.00	PASS
11AC40SISO	Ant1	5755	-11.10	0.19	-8.69	≤30.00	PASS
11AC40SISO	Ant1	5795	-11.18	0.19	-8.77	≤30.00	PASS
11AC80SISO	Ant1	5775	-12.87	0.23	-10.42	≤30.00	PASS

Note: 1.The cable loss, duty factor and RBW Factor are compensated in the graph.

2.Offset=cable loss + RBW Factor (2.22dB)+duty factor


Test GraphsB4

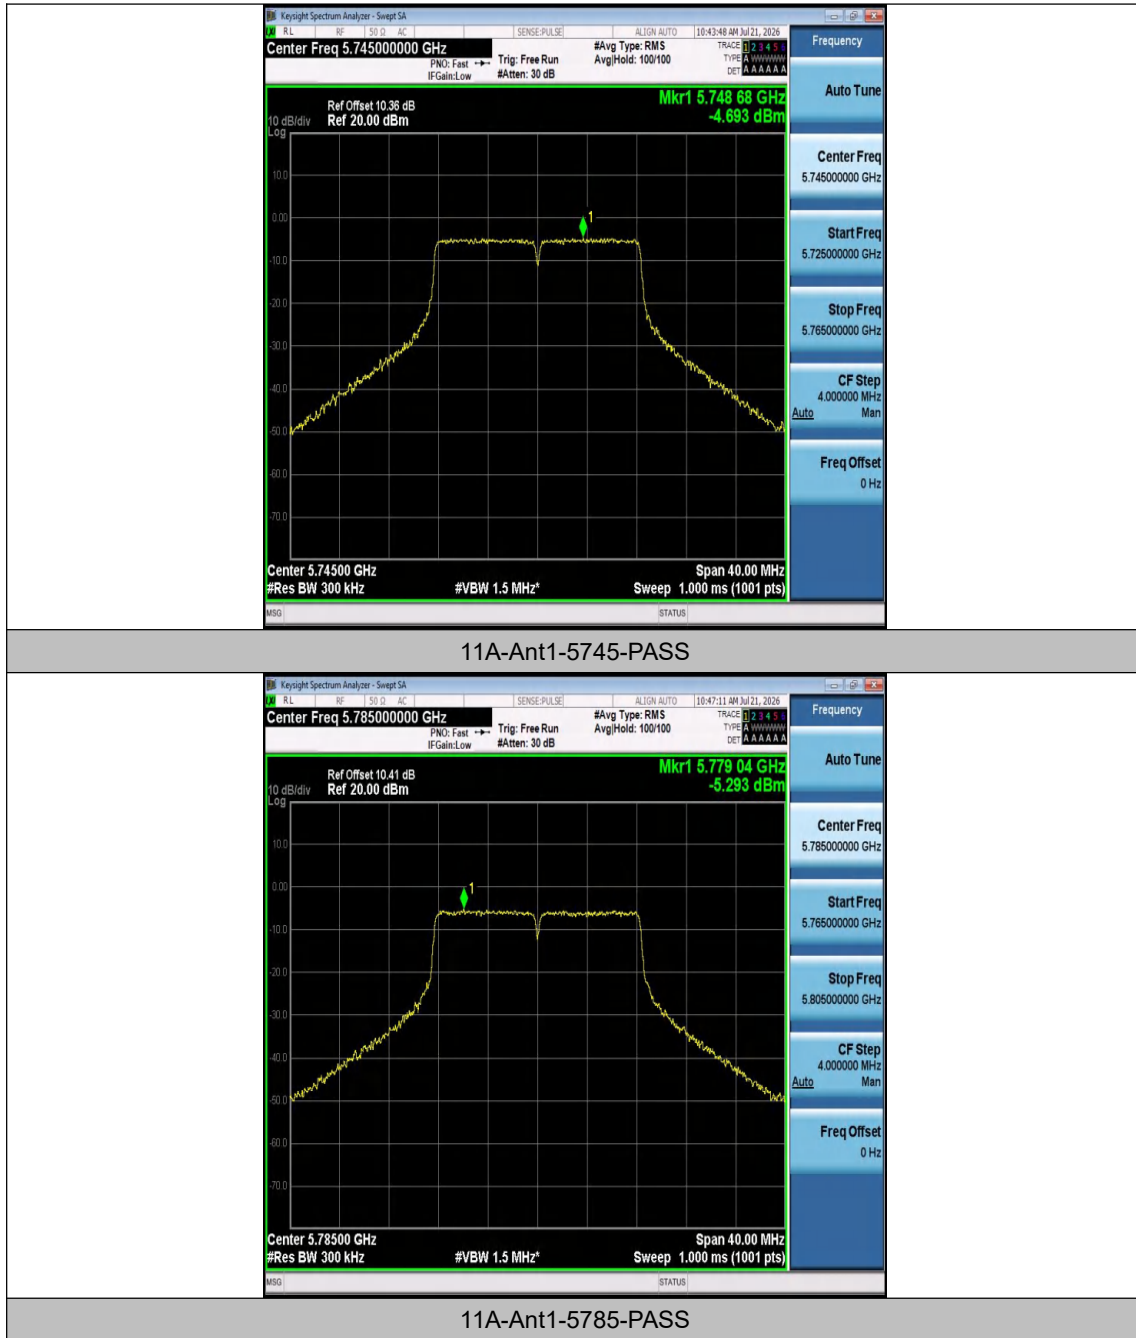

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

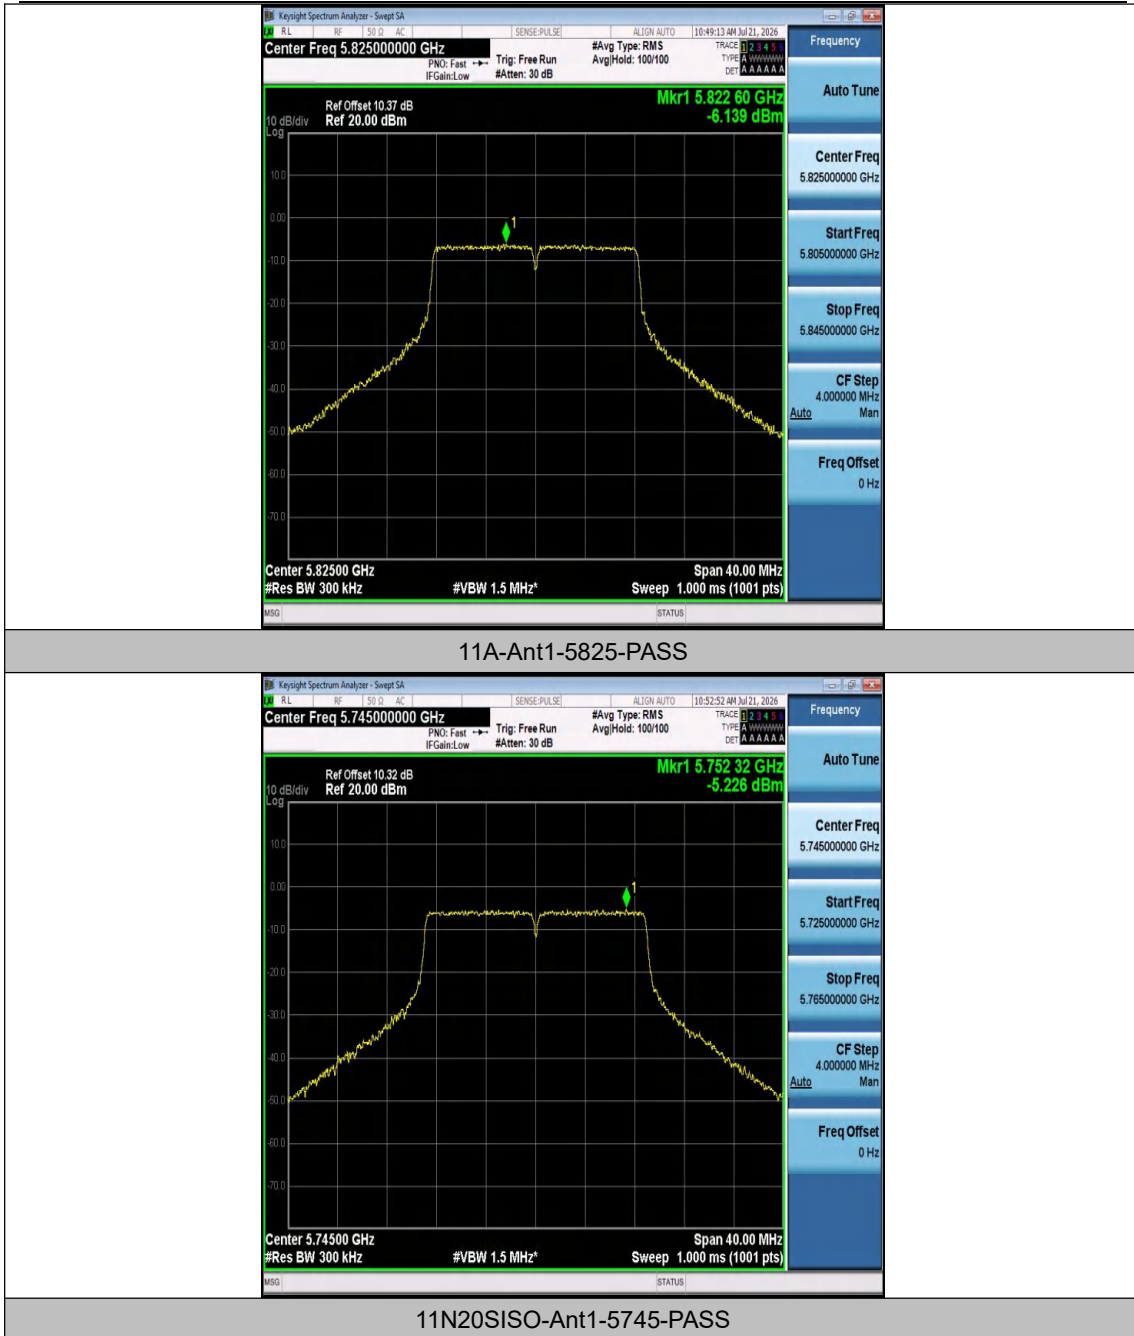

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

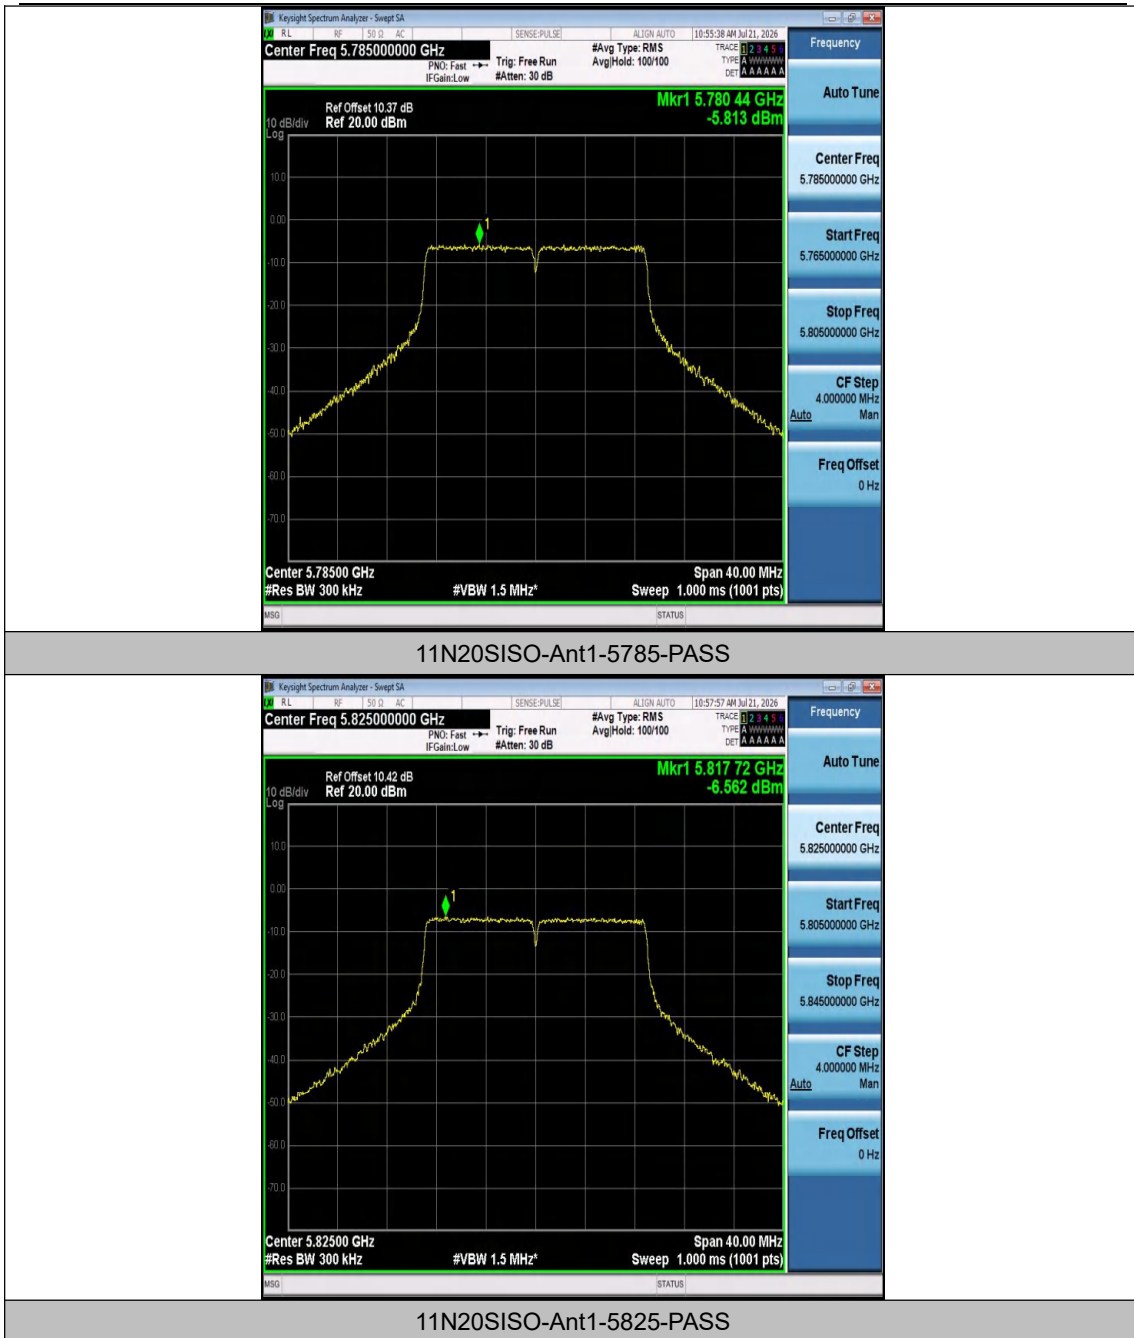

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

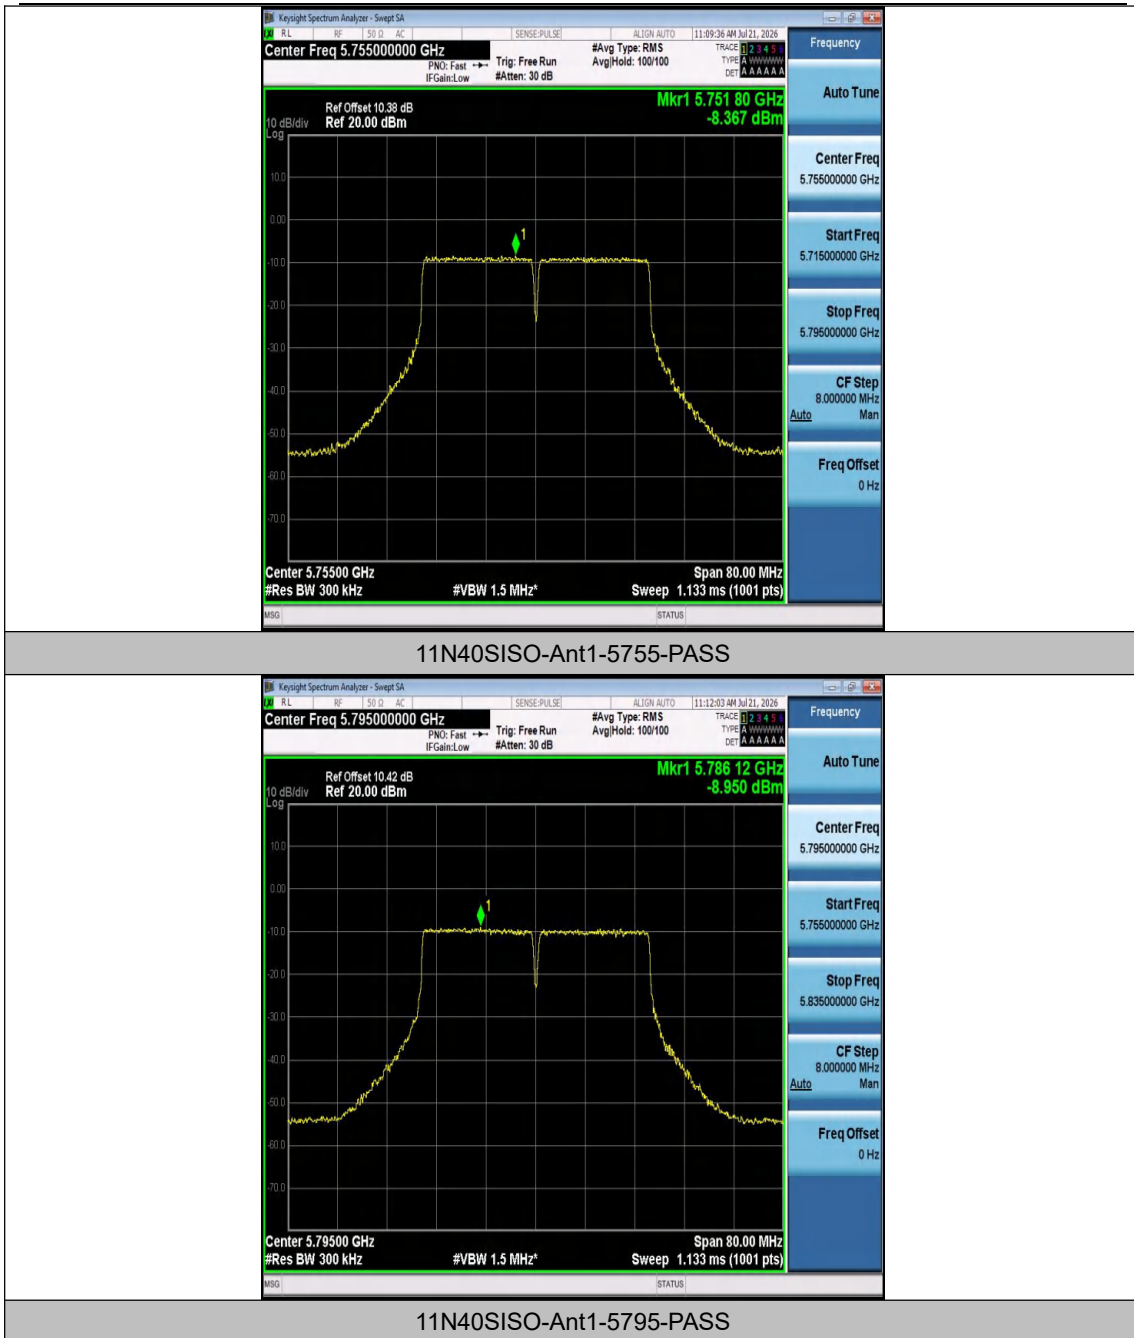

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

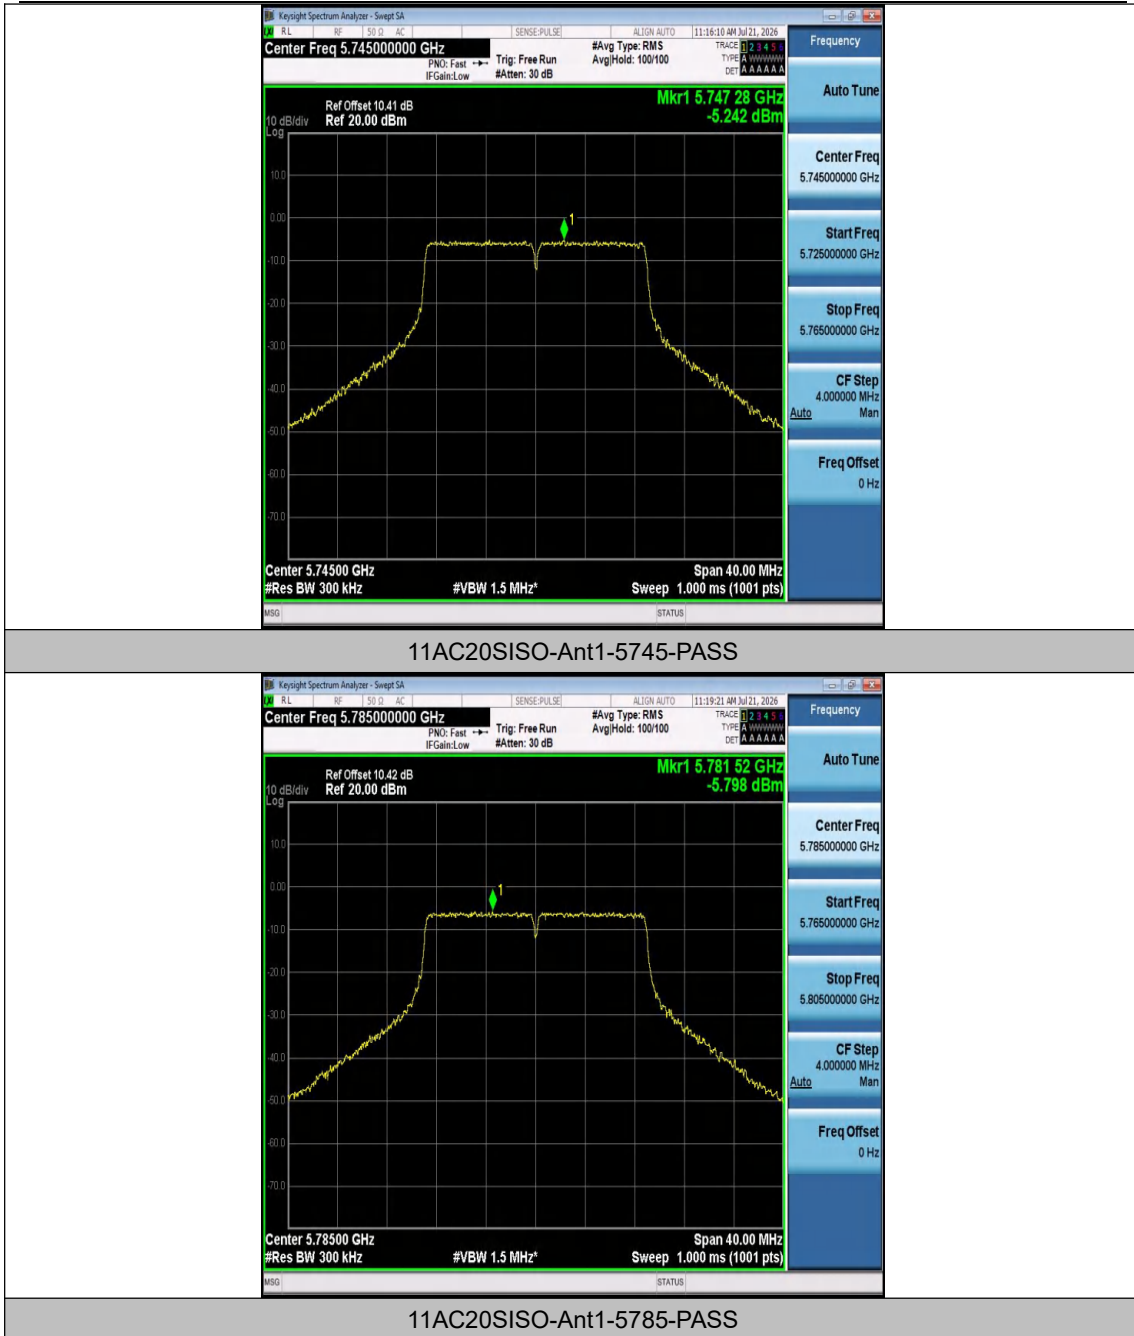

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

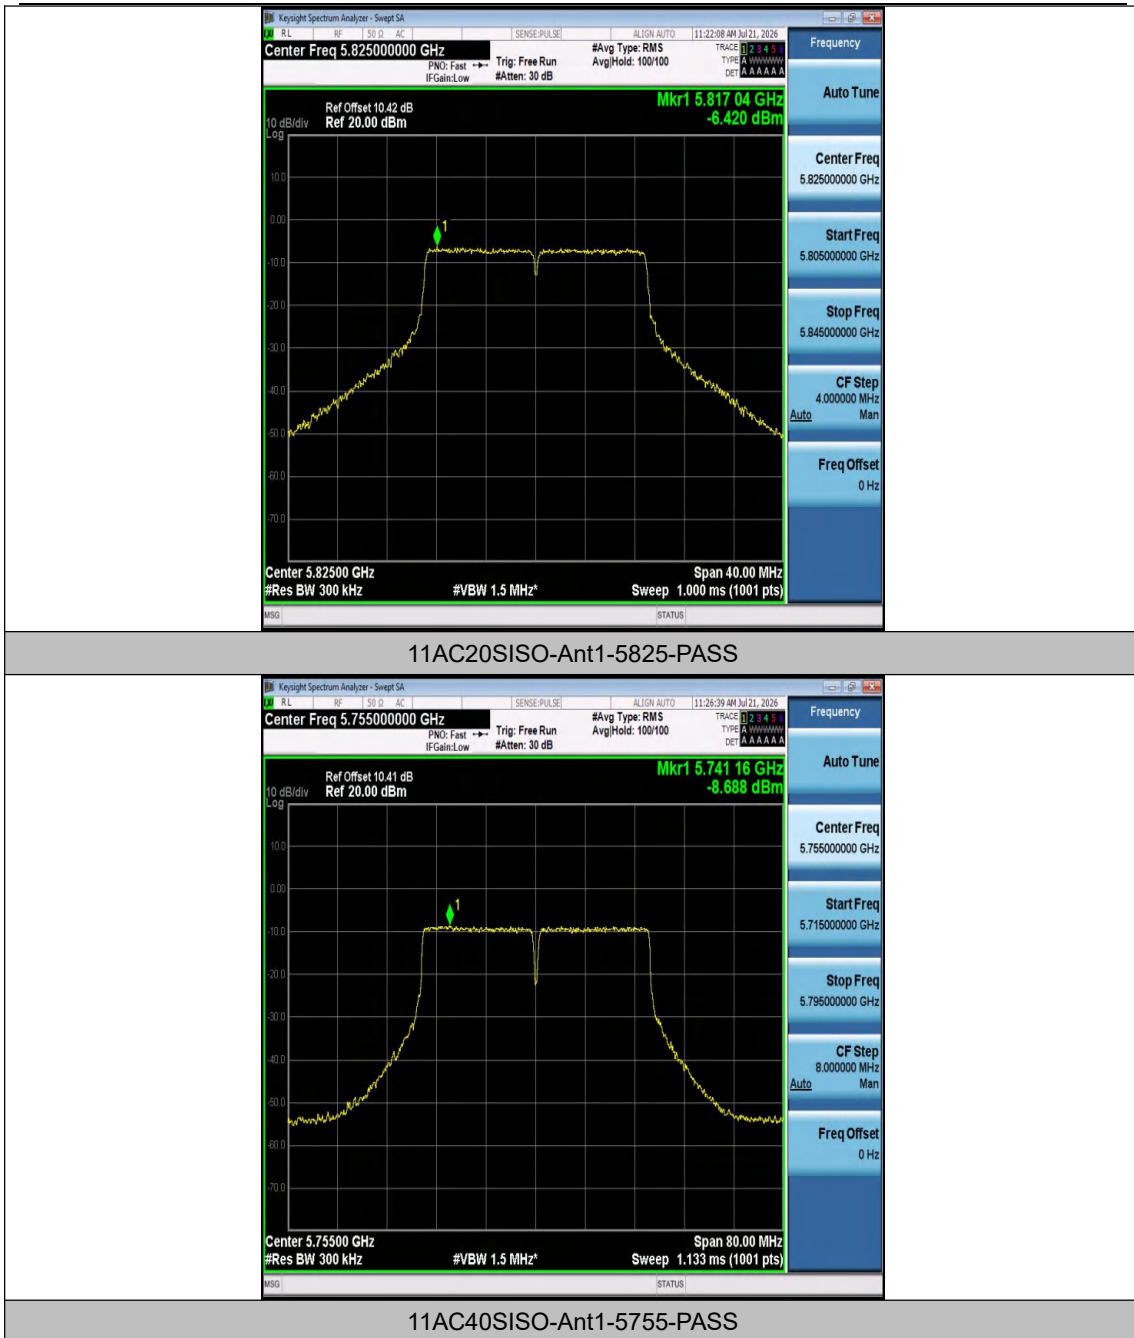

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

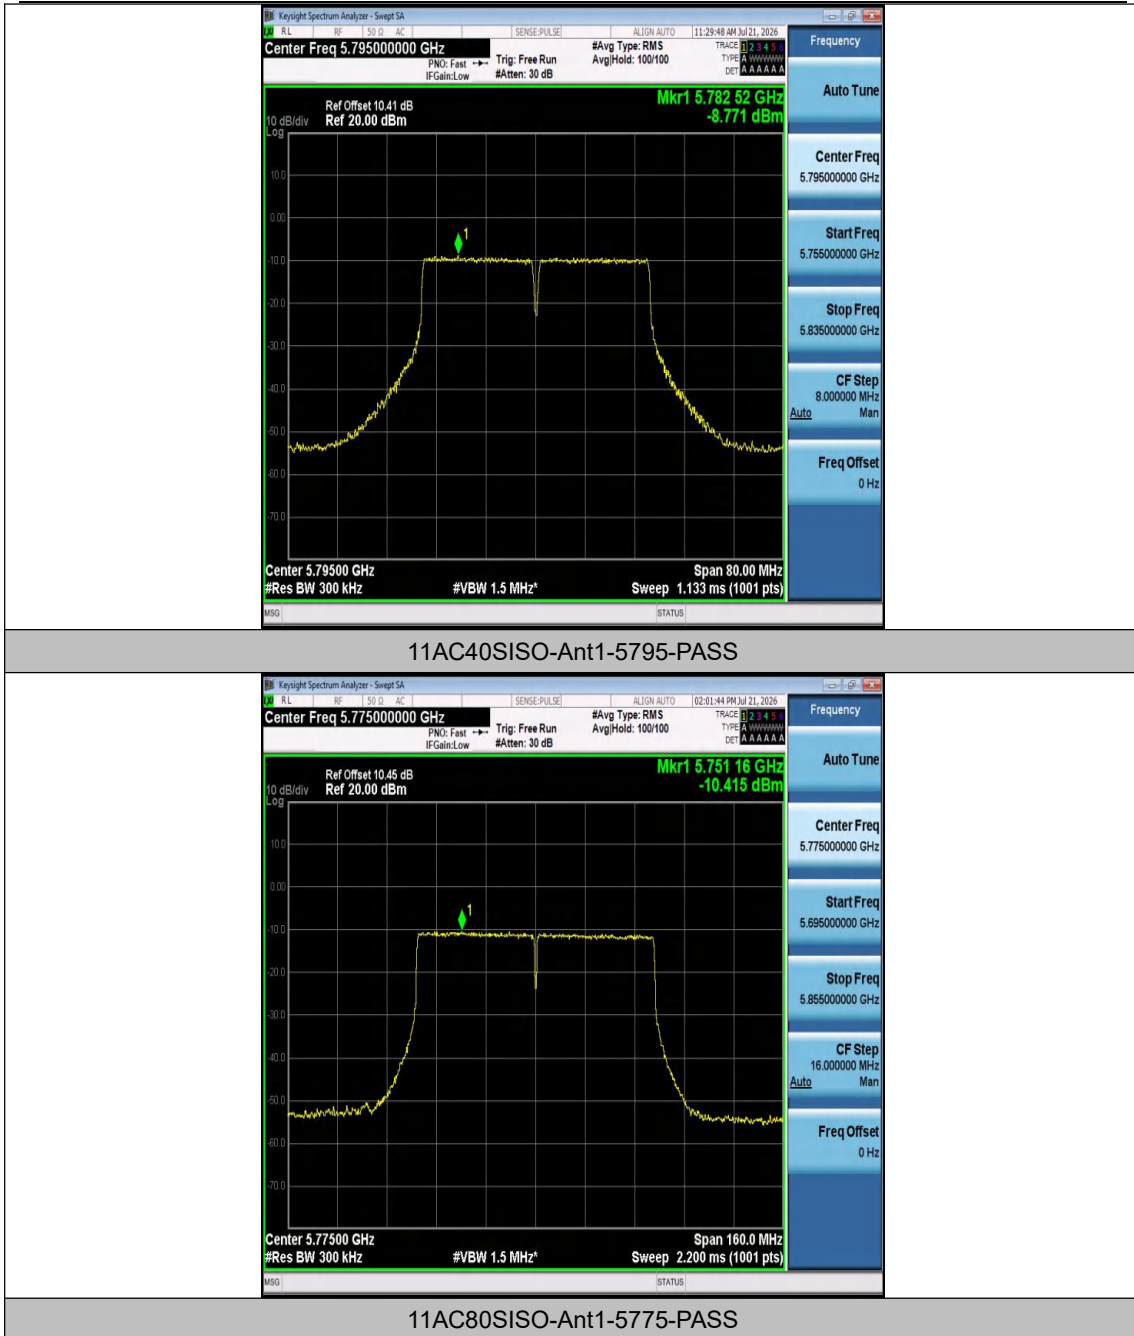

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix E: Band edge measurements

Test Result B4

Test Mode	Antenna	Ch. Name	Frequency[MHz]	FreqRange [MHz]	Result [dBm]	Limit [dBm]	Verdict
11A	Ant1	Low	5745	5720~5725	-26.95	≤21.32	PASS
11A	Ant1	Low	5745	5700~5720	-33.56	≤12.83	PASS
11A	Ant1	Low	5745	5650~5700	-40.76	≤-26.10	PASS
11A	Ant1	Low	5745	5760~5650	-41.21	≤-27	PASS
11A	Ant1	High	5825	5850~5855	-40.44	≤15.73	PASS
11A	Ant1	High	5825	5855~5875	-33.16	≤15.12	PASS
11A	Ant1	High	5825	5875~5925	-39.9	≤-26.31	PASS
11A	Ant1	High	5825	5925~5935	-40.03	≤-27	PASS
11N20SISO	Ant1	Low	5745	5720~5725	-24.67	≤15.82	PASS
11N20SISO	Ant1	Low	5745	5700~5720	-34.55	≤11.89	PASS
11N20SISO	Ant1	Low	5745	5650~5700	-40.35	≤-25.93	PASS
11N20SISO	Ant1	Low	5745	5760~5650	-40.33	≤-27	PASS
11N20SISO	Ant1	High	5825	5850~5855	-31.31	≤16.34	PASS
11N20SISO	Ant1	High	5825	5855~5875	-39.08	≤10.29	PASS
11N20SISO	Ant1	High	5825	5875~5925	-42.06	≤-26.71	PASS
11N20SISO	Ant1	High	5825	5925~5935	-40.8	≤-27	PASS
11N40SISO	Ant1	Low	5755	5720~5725	-31.08	≤21.28	PASS
11N40SISO	Ant1	Low	5755	5700~5720	-32.94	≤11.50	PASS
11N40SISO	Ant1	Low	5755	5650~5700	-39.46	≤-26.20	PASS
11N40SISO	Ant1	Low	5755	5780~5650	-40.94	≤-27	PASS
11N40SISO	Ant1	High	5795	5850~5855	-42.02	≤15.66	PASS
11N40SISO	Ant1	High	5795	5855~5875	-40.67	≤10.43	PASS
11N40SISO	Ant1	High	5795	5875~5925	-41.77	≤-26.95	PASS
11N40SISO	Ant1	High	5795	5925~5935	-40.68	≤-27	PASS
11AC20SISO	Ant1	Low	5745	5720~5725	-33.95	≤17.13	PASS
11AC20SISO	Ant1	Low	5745	5700~5720	-31.97	≤13.95	PASS
11AC20SISO	Ant1	Low	5745	5650~5700	-41.93	≤-26.87	PASS
11AC20SISO	Ant1	Low	5745	5760~5650	-41.35	≤-27	PASS
11AC20SISO	Ant1	High	5825	5850~5855	-40.94	≤15.73	PASS
11AC20SISO	Ant1	High	5825	5855~5875	-36.12	≤13.69	PASS
11AC20SISO	Ant1	High	5825	5875~5925	-40.02	≤-26.81	PASS
11AC20SISO	Ant1	High	5825	5925~5935	-40.47	≤-27	PASS
11AC40SISO	Ant1	Low	5755	5720~5725	-31.57	≤20.35	PASS
11AC40SISO	Ant1	Low	5755	5700~5720	-29.6	≤14.48	PASS
11AC40SISO	Ant1	Low	5755	5650~5700	-42.82	≤-26.90	PASS

11AC40SISO	Ant1	Low	5755	5780~5650	-41.26	≤ -27	PASS
11AC40SISO	Ant1	High	5795	5850~5855	-37.59	≤ 17.16	PASS
11AC40SISO	Ant1	High	5795	5855~5875	-39.64	≤ 10.48	PASS
11AC40SISO	Ant1	High	5795	5875~5925	-40.87	≤ -26.95	PASS
11AC40SISO	Ant1	High	5795	5925~5935	-40.22	≤ -27	PASS
11AC80SISO	Ant1	Low	5775	5720~5725	-34.21	≤ 18.12	PASS
11AC80SISO	Ant1	Low	5775	5700~5720	-29.13	≤ 12.87	PASS
11AC80SISO	Ant1	Low	5775	5650~5700	-41.91	≤ -26.46	PASS
11AC80SISO	Ant1	Low	5775	5800~5650	-39.76	≤ -27	PASS

Note: The margin plus the antenna gain also meets the limit.

Test Graphs B4



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

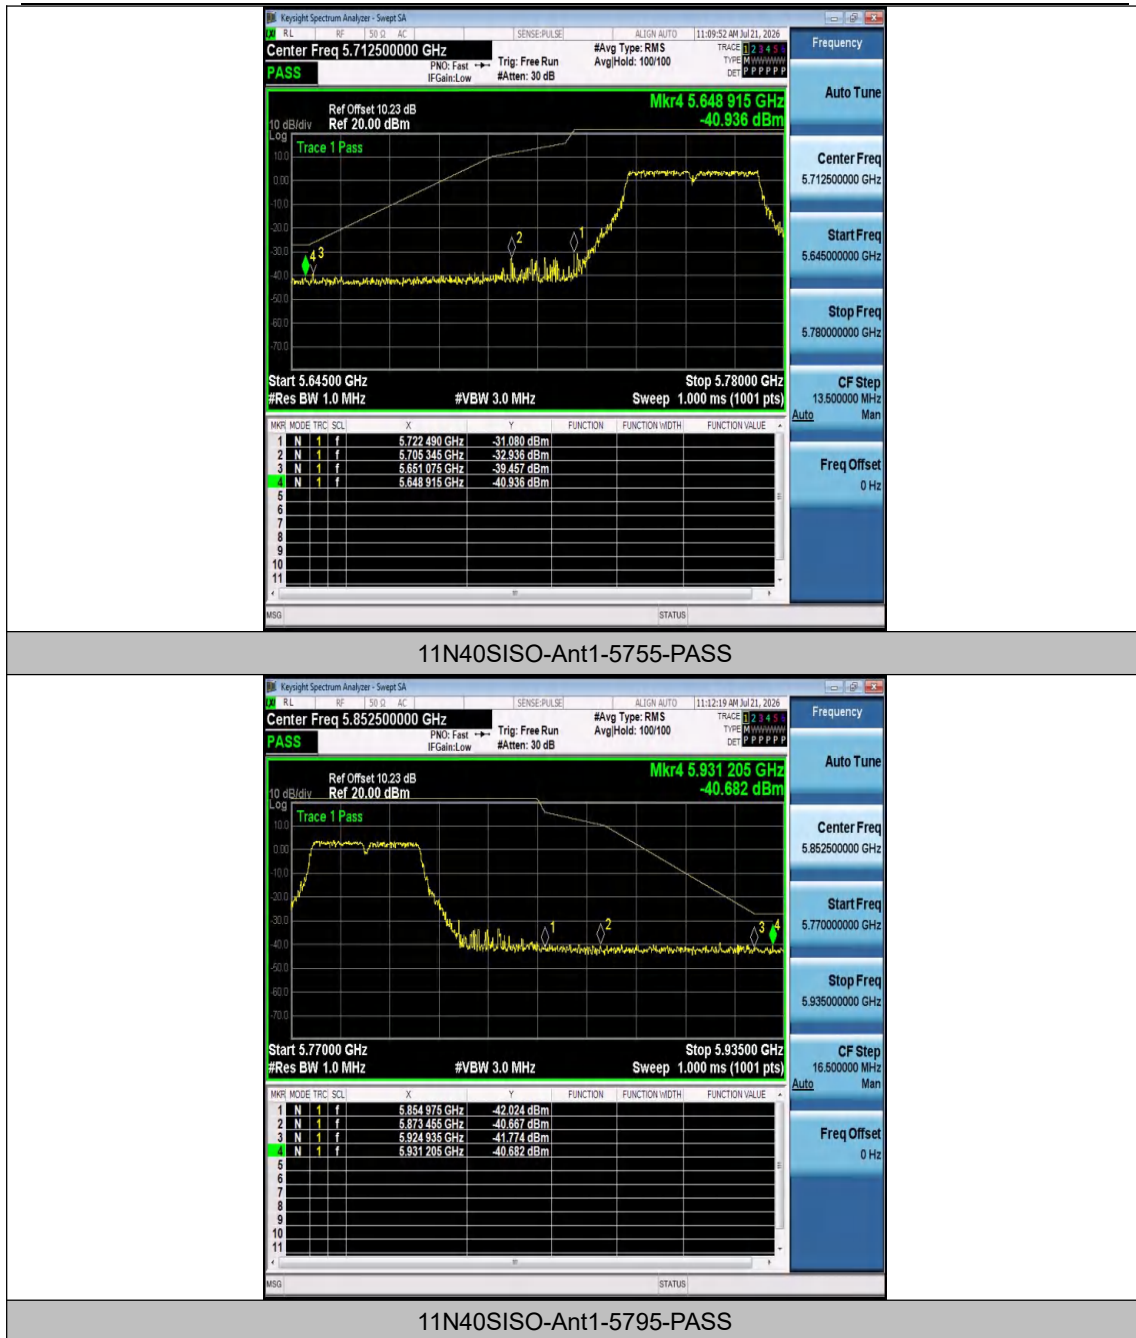

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

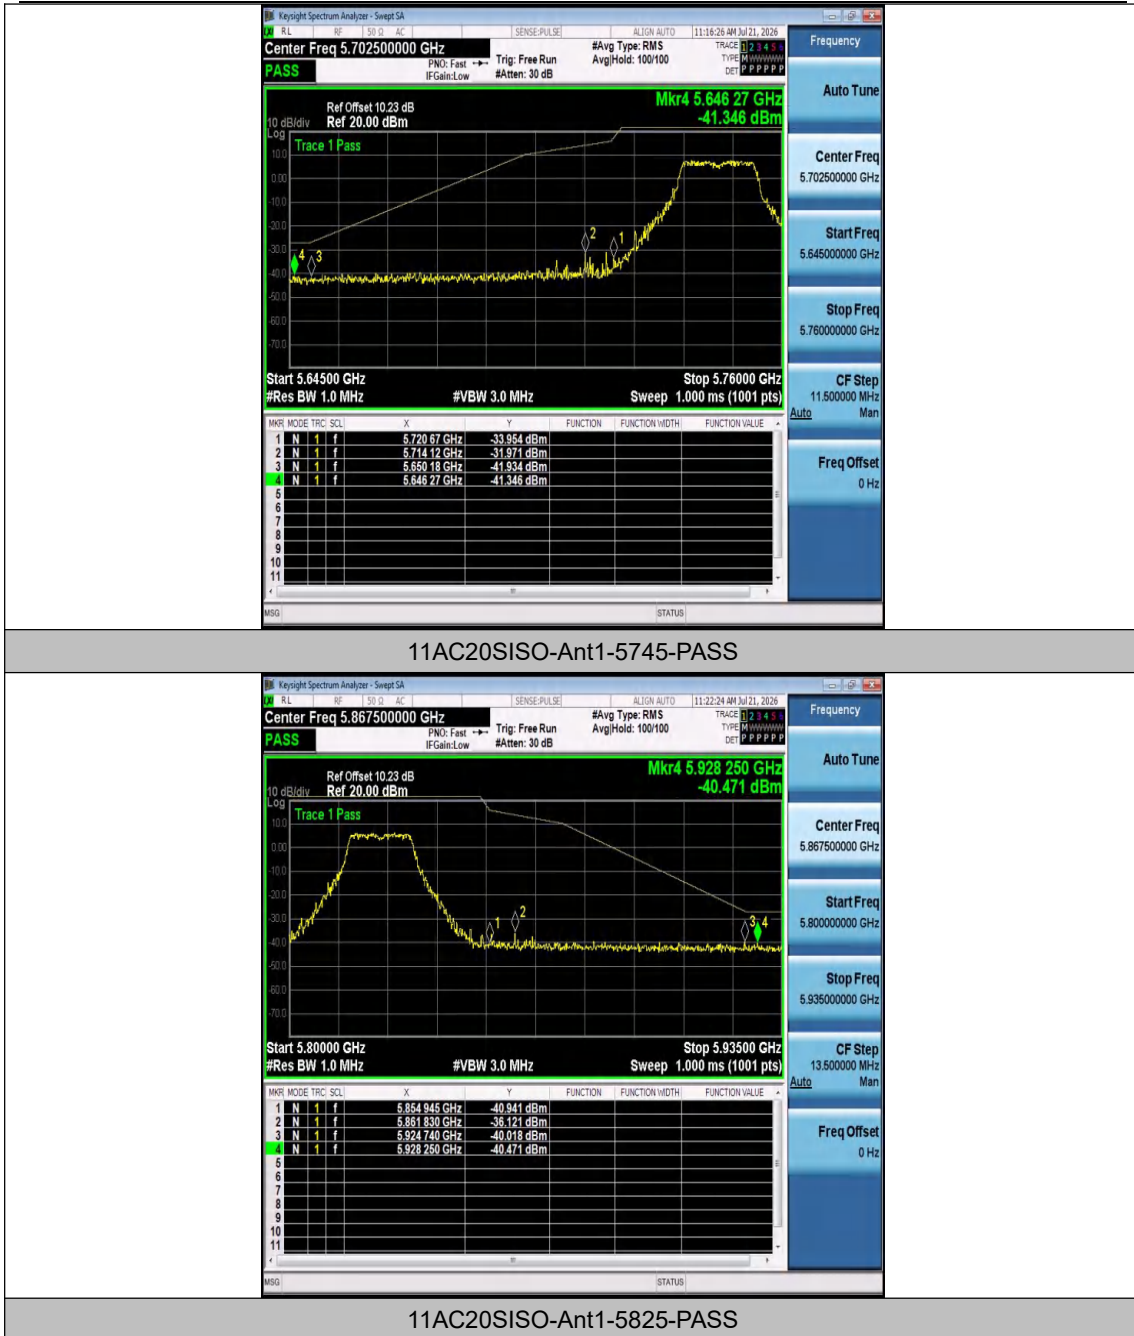


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

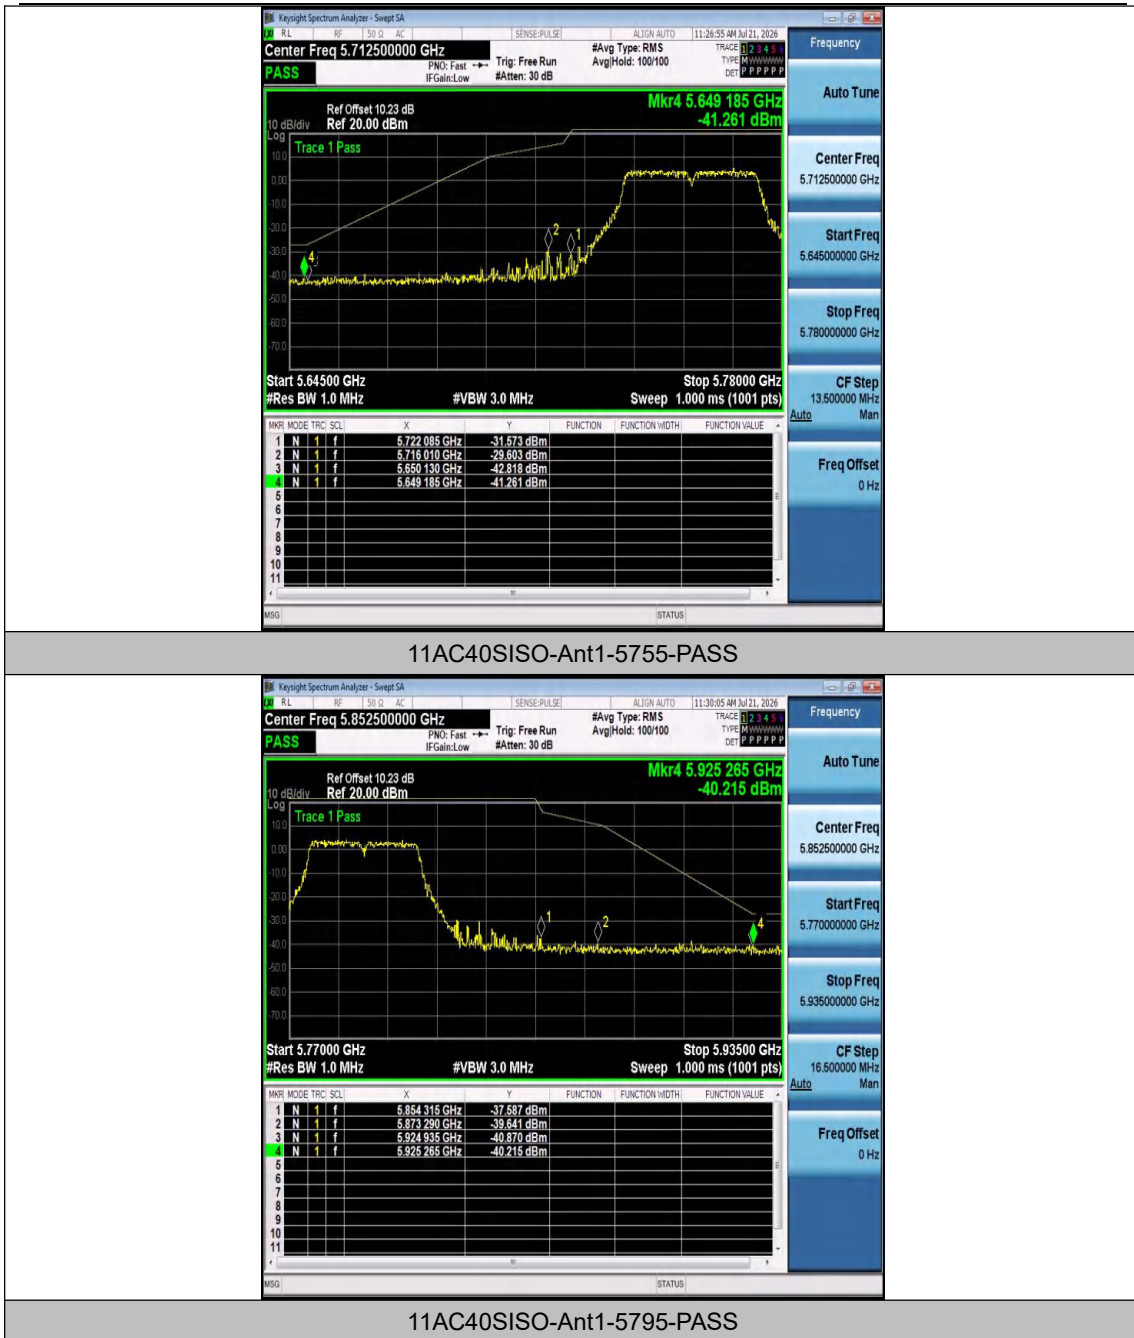

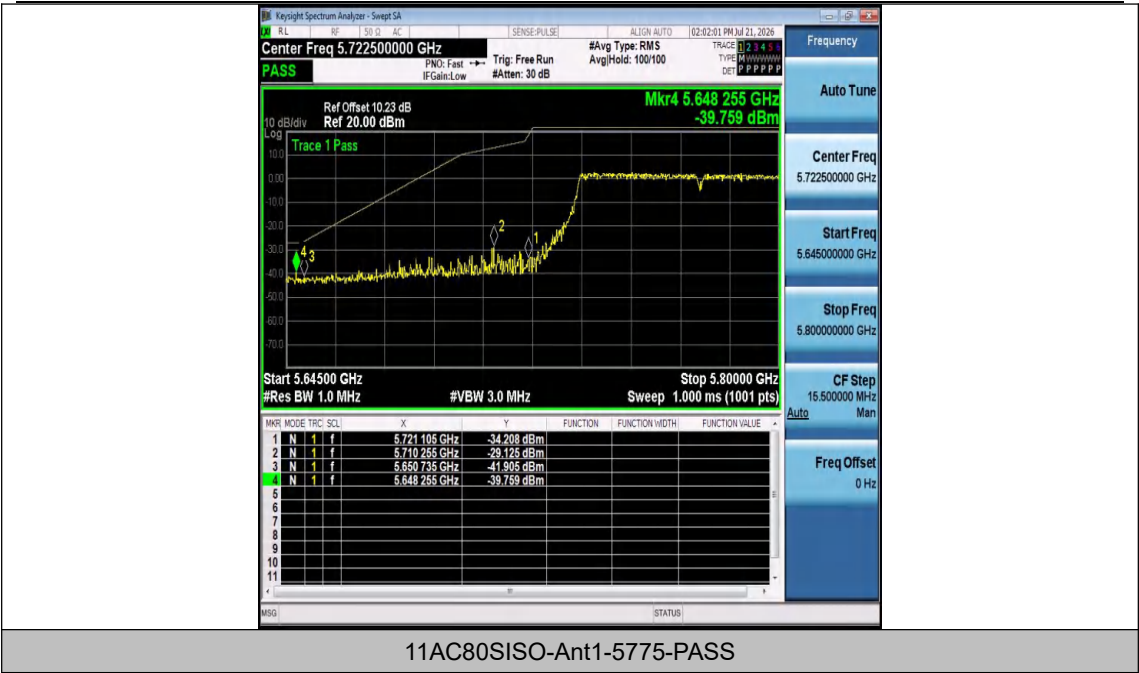

---END---