




BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

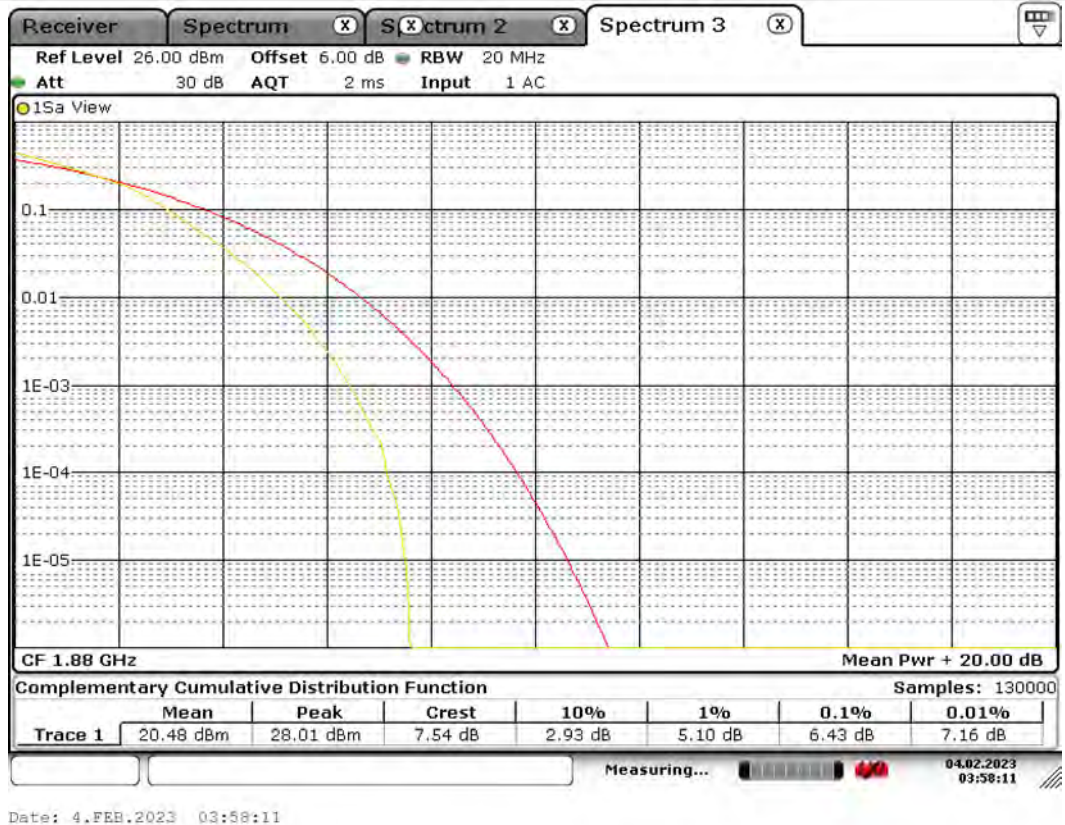

Band2-20MHz-16QAM-19100-1RB#0




Band2-20MHz-16QAM-19100-100RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

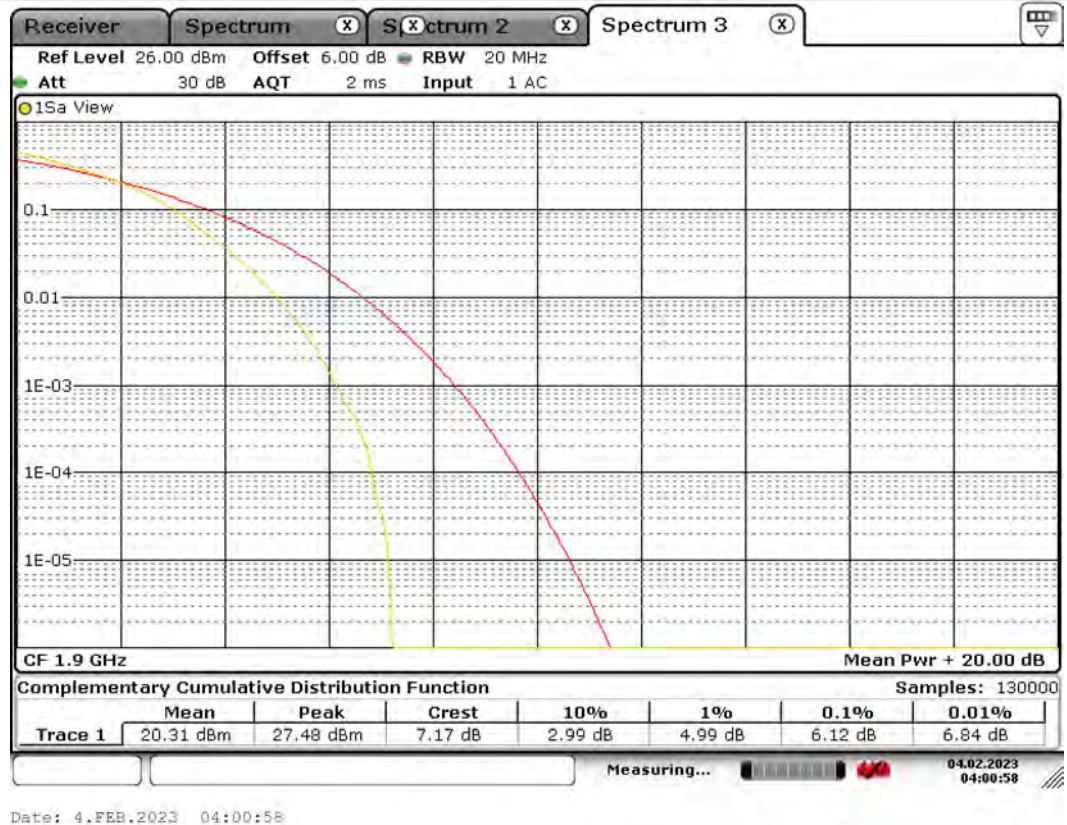

Band2-20MHz-64QAM-18700-1RB#0




Band2-20MHz-64QAM-18700-100RB#0




BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

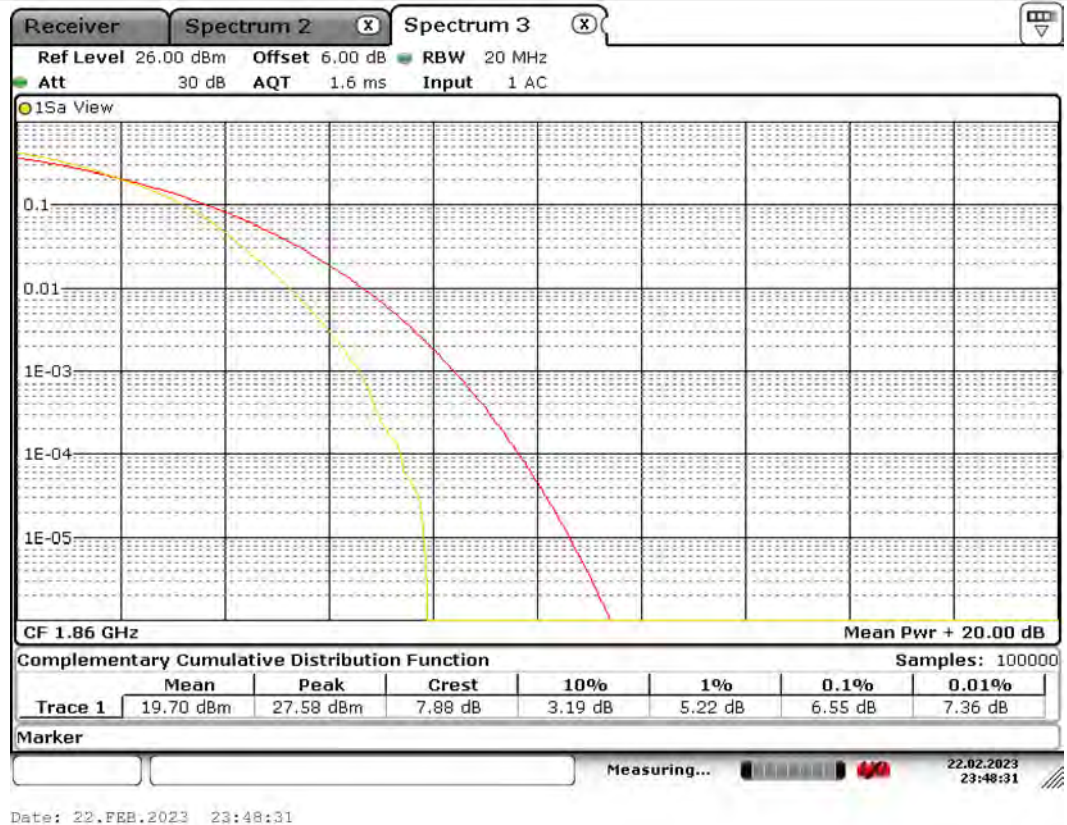

Band2-20MHz-64QAM-18900-1RB#0

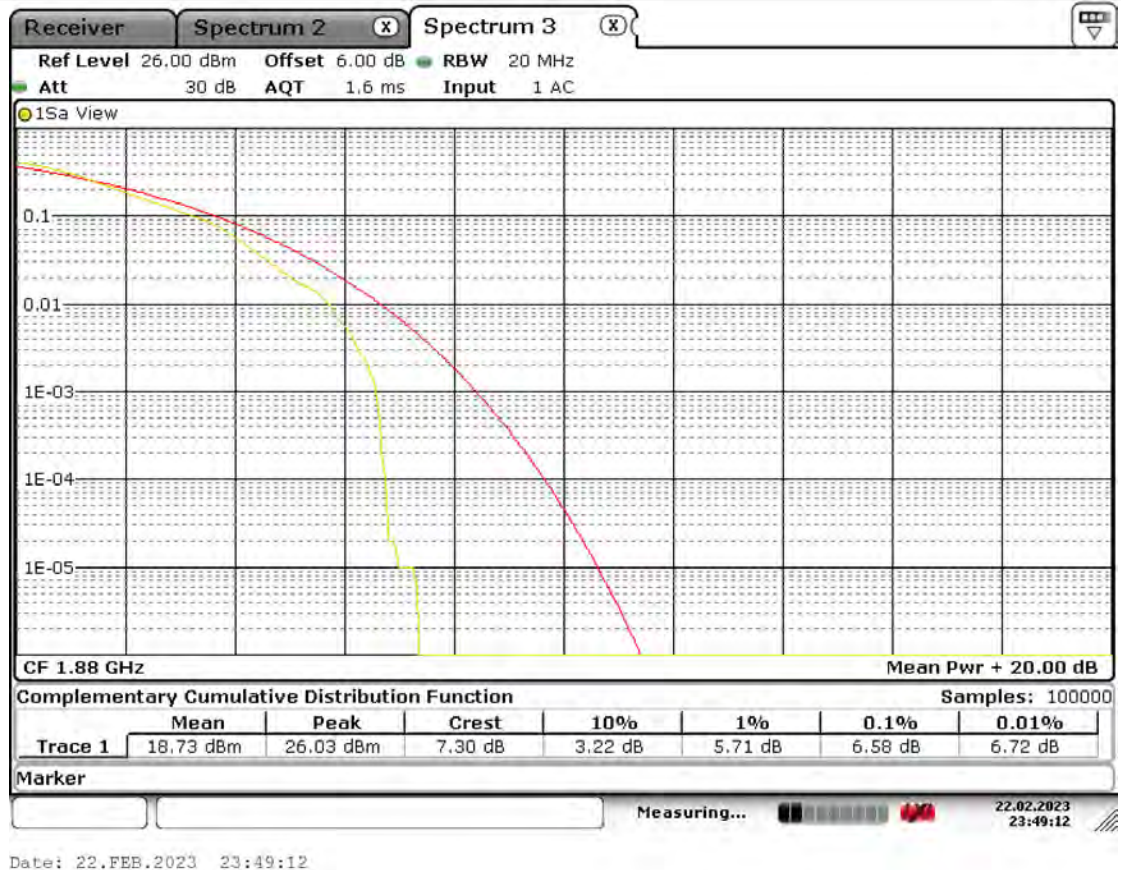




BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

Band2-20MHz-64QAM-18900-100RB#0

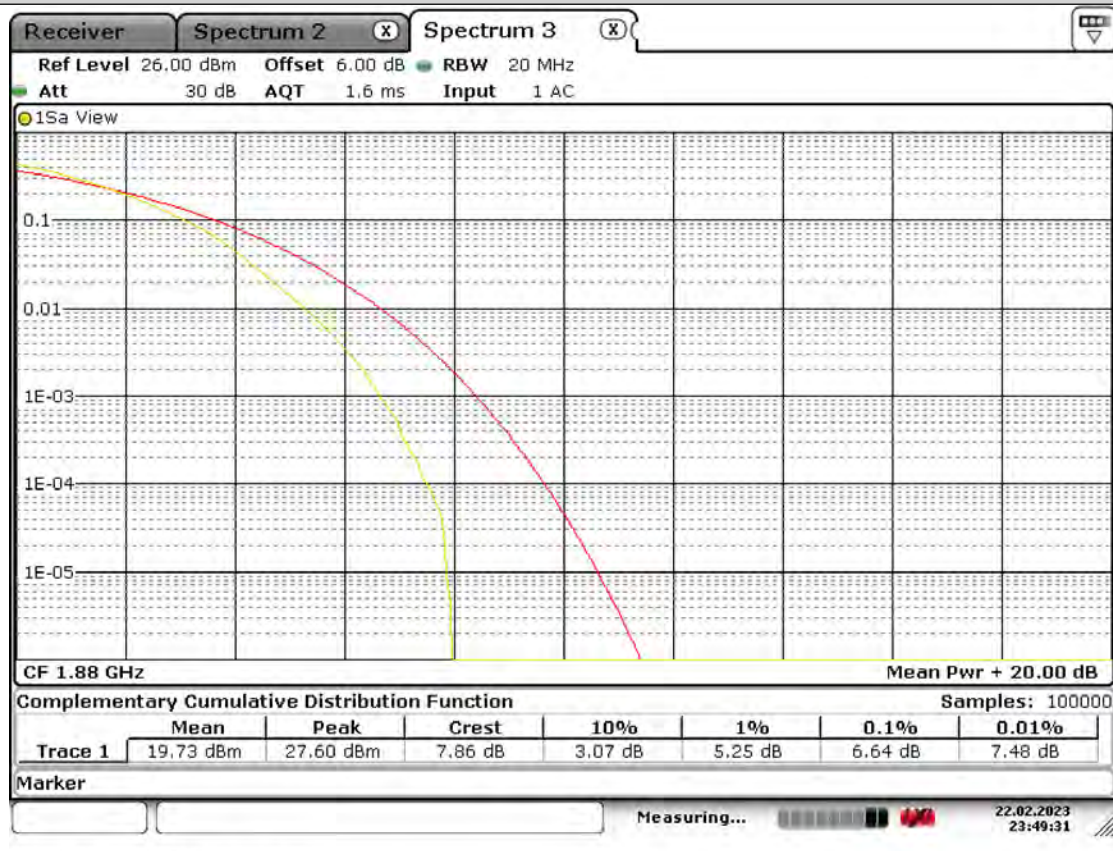


Date: 22.FEB.2023 23:49:31

Band2-20MHz-64QAM-19100-1RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

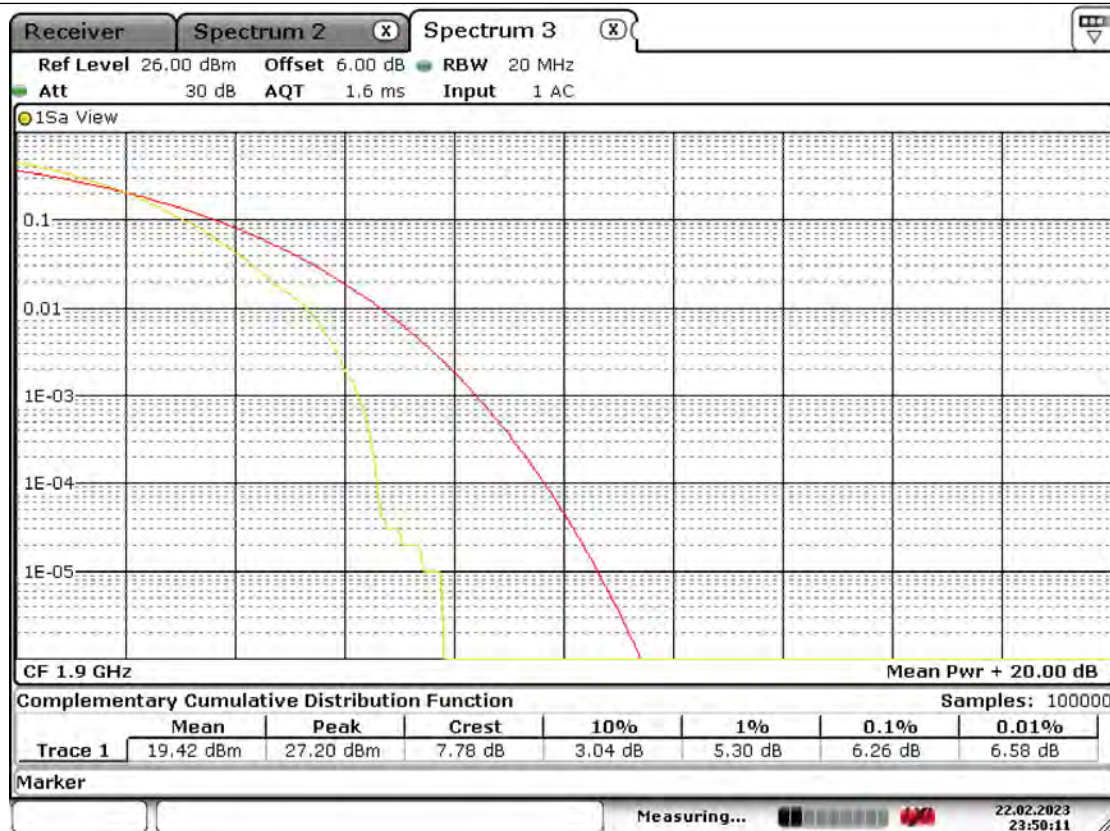


Date: 22.FEB.2023 23:50:11

Band2-20MHz-64QAM-19100-100RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

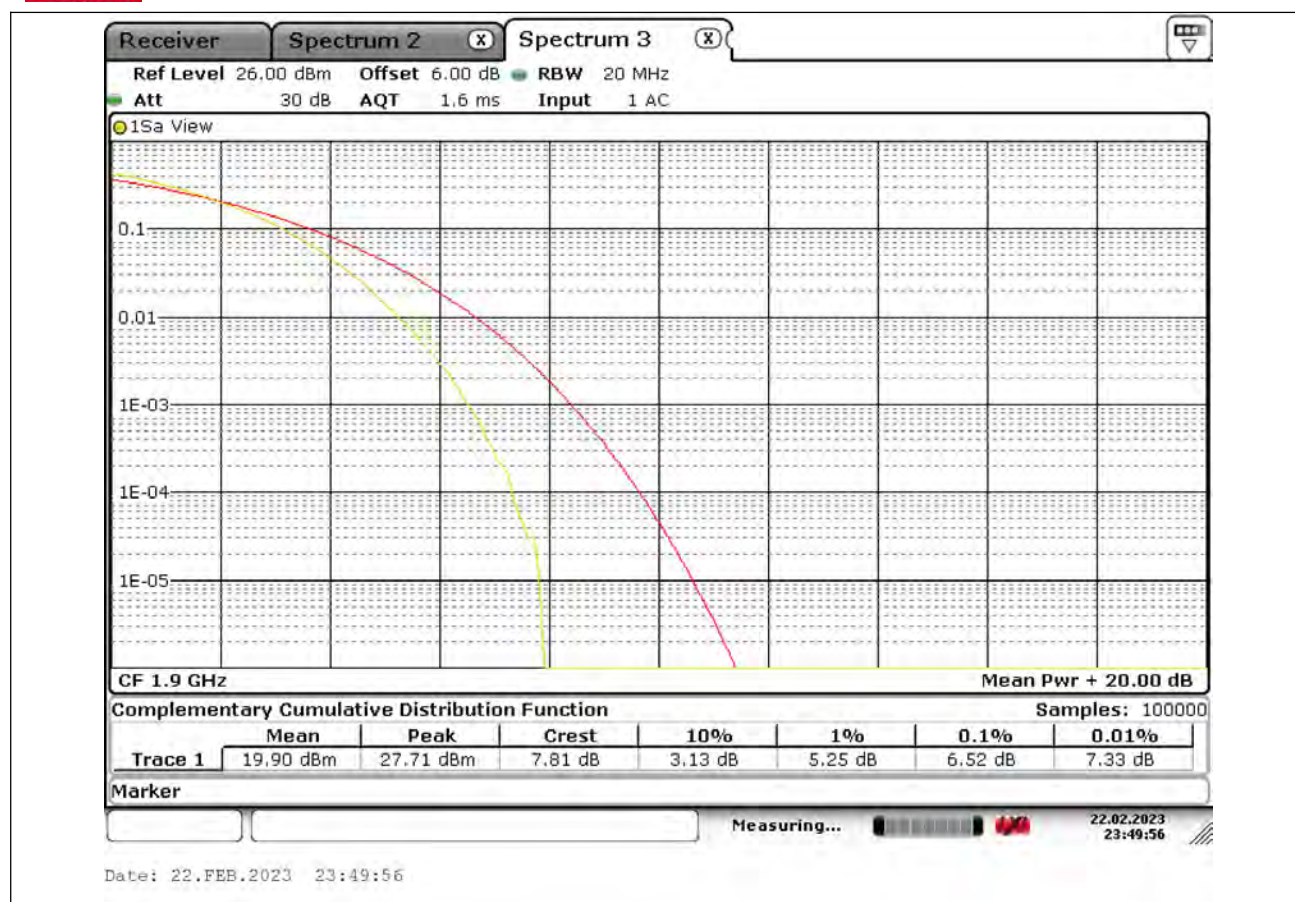

**26DB BANDWIDTH AND OCCUPIED BANDWIDTH****Test Result**


Band	Bandwidth	Modulation	Channel	RB Configuration	Occupied Bandwidth (MHz)	26dB Bandwidth (MHz)	Verdict
Band2	1.4MHz	QPSK	18607	6RB#0	1.102	1.248	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	1.094	1.2359	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	1.098	1.2399	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	1.098	1.248	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	1.098	1.2399	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	1.094	1.2399	PASS
Band2	3MHz	QPSK	18615	15RB#0	2.726	3.0564	PASS
Band2	3MHz	QPSK	18900	15RB#0	2.718	3.0738	PASS
Band2	3MHz	QPSK	19185	15RB#0	2.718	3.1085	PASS
Band2	3MHz	16QAM	18615	15RB#0	2.718	3.0738	PASS
Band2	3MHz	16QAM	18900	15RB#0	2.753	3.0391	PASS
Band2	3MHz	16QAM	19185	15RB#0	2.700	3.0825	PASS
Band2	5MHz	QPSK	18625	25RB#0	4.486	4.935	PASS
Band2	5MHz	QPSK	18900	25RB#0	4.486	4.891	PASS
Band2	5MHz	QPSK	19175	25RB#0	4.486	4.863	PASS
Band2	5MHz	16QAM	18625	25RB#0	4.472	4.935	PASS
Band2	5MHz	16QAM	18900	25RB#0	4.515	4.863	PASS
Band2	5MHz	16QAM	19175	25RB#0	4.472	4.891	PASS
Band2	10MHz	QPSK	18650	50RB#0	9.030	9.783	PASS
Band2	10MHz	QPSK	18900	50RB#0	9.059	9.725	PASS
Band2	10MHz	QPSK	19150	50RB#0	9.088	9.783	PASS
Band2	10MHz	16QAM	18650	50RB#0	9.001	9.841	PASS
Band2	10MHz	16QAM	18900	50RB#0	9.030	9.725	PASS
Band2	10MHz	16QAM	19150	50RB#0	9.059	9.957	PASS
Band2	15MHz	QPSK	18675	75RB#0	13.459	14.718	PASS
Band2	15MHz	QPSK	18900	75RB#0	13.459	14.544	PASS
Band2	15MHz	QPSK	19125	75RB#0	13.502	14.588	PASS
Band2	15MHz	16QAM	18675	75RB#0	13.502	14.457	PASS
Band2	15MHz	16QAM	18900	75RB#0	13.459	14.414	PASS
Band2	15MHz	16QAM	19125	75RB#0	13.459	14.414	PASS
Band2	20MHz	QPSK	18700	100RB#0	18.350	20.318	PASS
Band2	20MHz	QPSK	18900	100RB#0	18.466	20.376	PASS
Band2	20MHz	QPSK	19100	100RB#0	18.408	20.203	PASS
Band2	20MHz	16QAM	18700	100RB#0	18.466	20.145	PASS
Band2	20MHz	16QAM	18900	100RB#0	18.408	20.203	PASS
Band2	20MHz	16QAM	19100	100RB#0	18.408	20.203	PASS
Band2	1.4MHz	64QAM	18607	6RB#0	1.102	1.2318	PASS
Band2	1.4MHz	64QAM	18900	6RB#0	1.090	1.2318	PASS
Band2	1.4MHz	64QAM	19193	6RB#0	1.090	1.248	PASS
Band2	3MHz	64QAM	18615	15RB#0	2.726	3.0304	PASS
Band2	3MHz	64QAM	18900	15RB#0	2.709	3.0391	PASS



Test Report No.: PSU-QSU2308280314RF02

Band2	3MHz	64QAM	19185	15RB#0	2.735	3.0825	PASS
Band2	5MHz	64QAM	18625	25RB#0	4.486	4.964	PASS
Band2	5MHz	64QAM	18900	25RB#0	4.501	4.935	PASS
Band2	5MHz	64QAM	19175	25RB#0	4.486	4.949	PASS
Band2	10MHz	64QAM	18650	50RB#0	9.001	9.783	PASS
Band2	10MHz	64QAM	18900	50RB#0	9.030	9.667	PASS
Band2	10MHz	64QAM	19150	50RB#0	9.059	9.986	PASS
Band2	15MHz	64QAM	18675	75RB#0	13.459	14.674	PASS
Band2	15MHz	64QAM	18900	75RB#0	13.459	14.848	PASS
Band2	15MHz	64QAM	19125	75RB#0	13.415	14.457	PASS
Band2	20MHz	64QAM	18700	100RB#0	18.350	20.203	PASS
Band2	20MHz	64QAM	18900	100RB#0	18.408	20.550	PASS
Band2	20MHz	64QAM	19100	100RB#0	18.408	20.145	PASS


Test Graphs

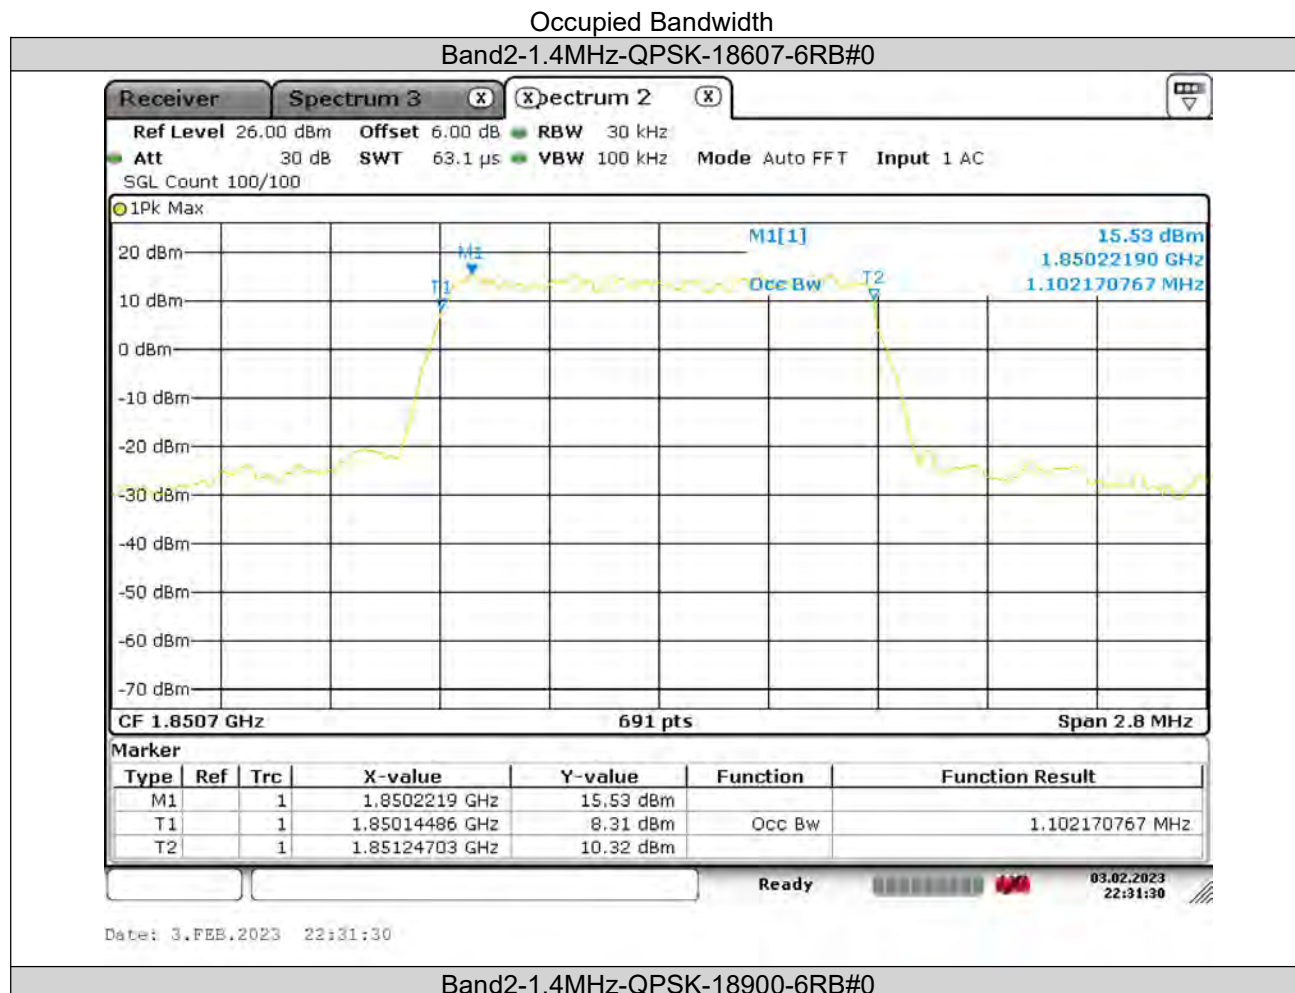



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

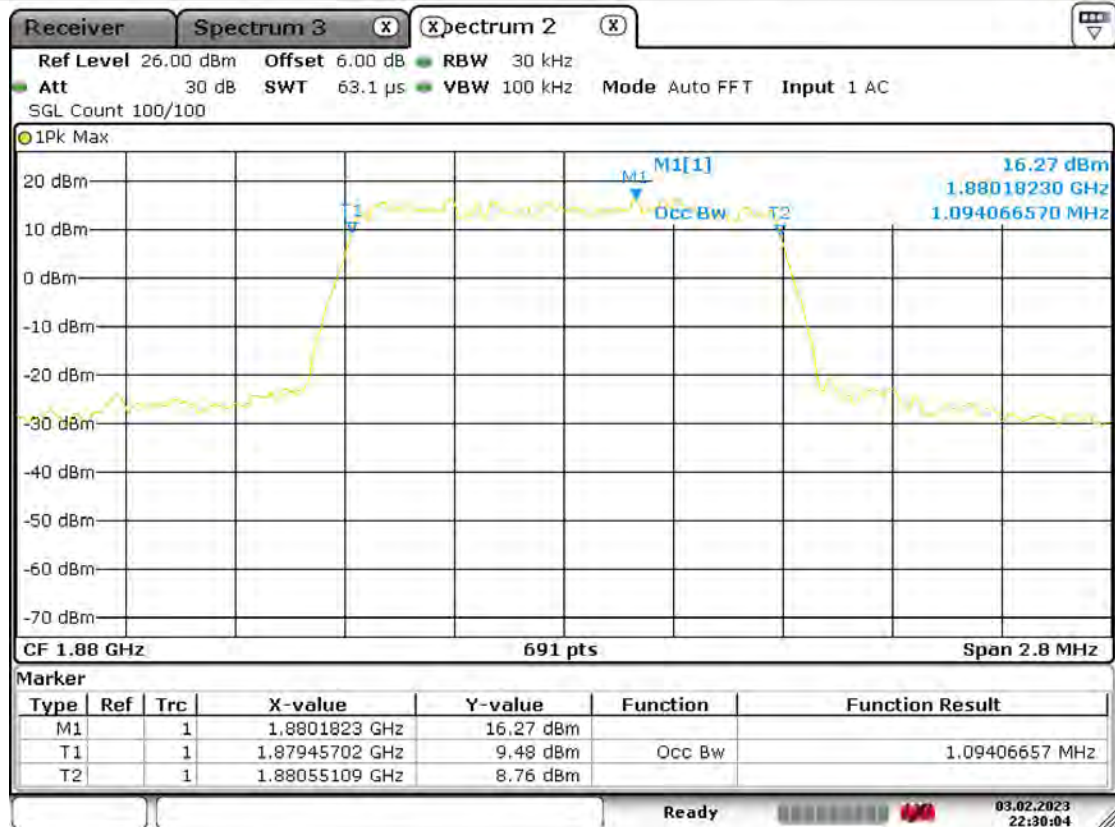


Date: 3.FEB.2023 22:30:04

Band2-1.4MHz-QPSK-19193-6RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

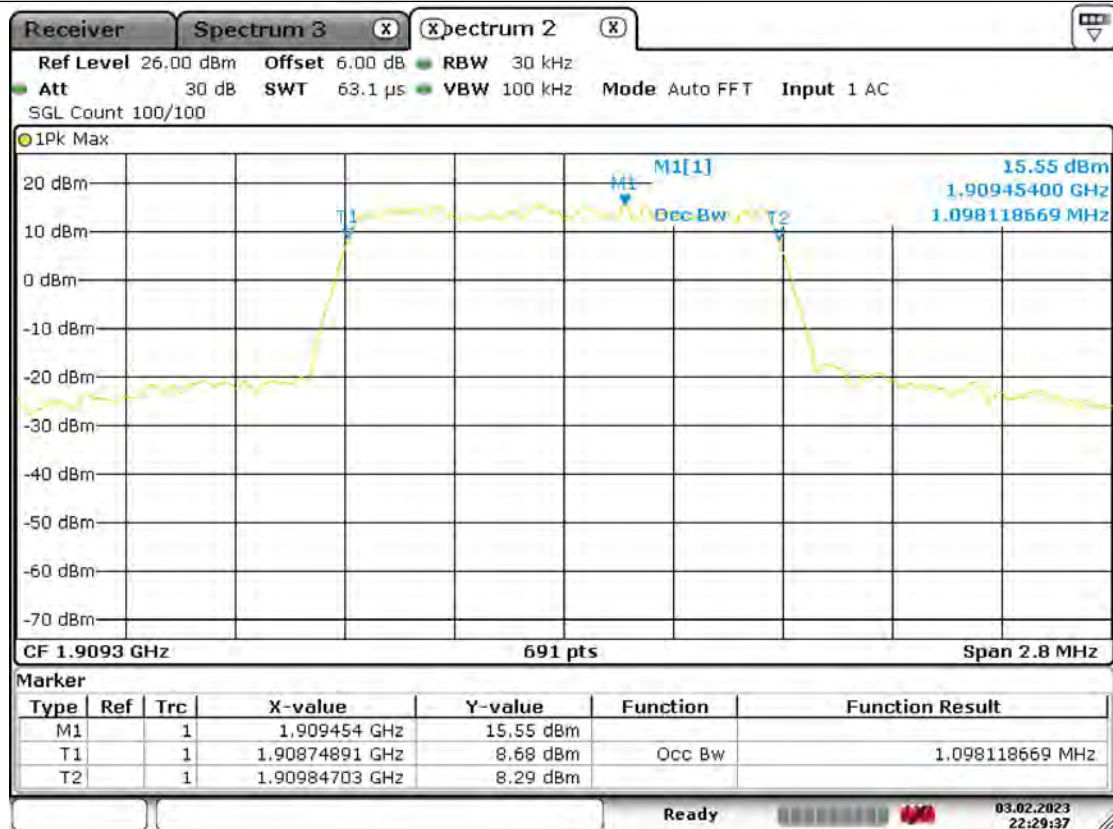


Date: 3.FEB.2023 22:29:37

Band2-1.4MHz-16QAM-18607-6RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

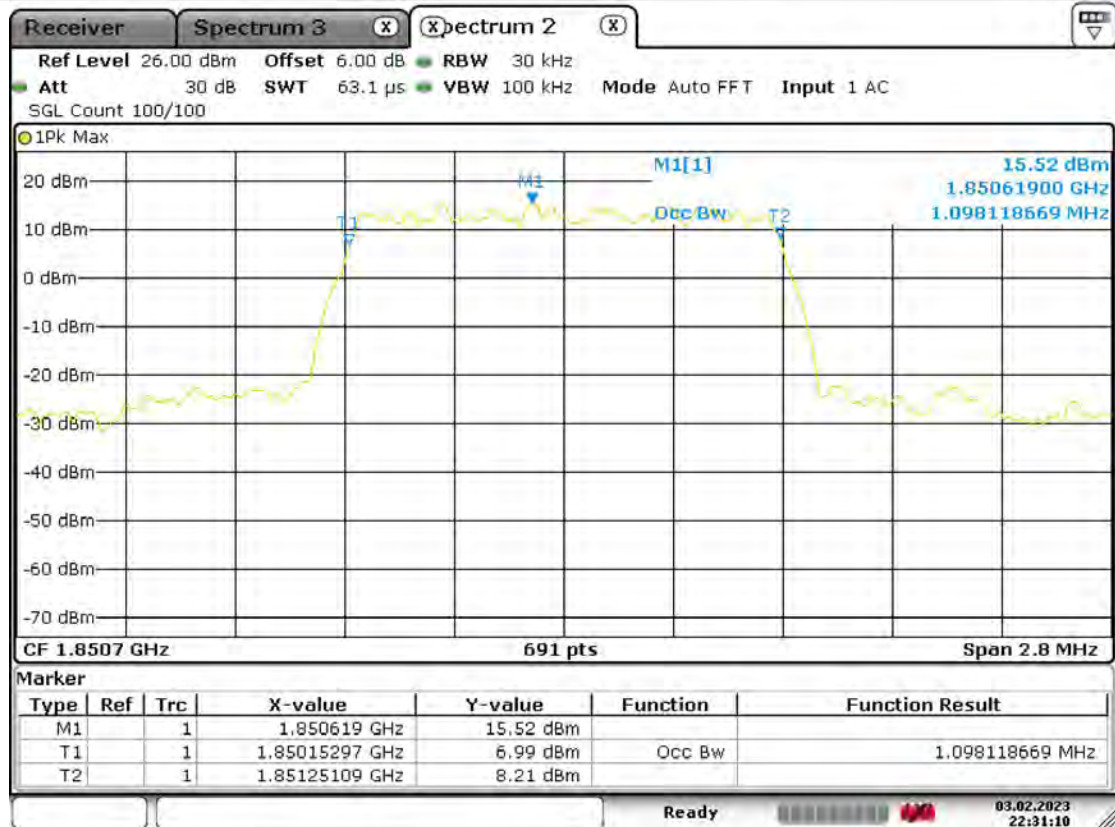


Date: 3.FEB.2023 22:31:10

Band2-1.4MHz-16QAM-18900-6RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

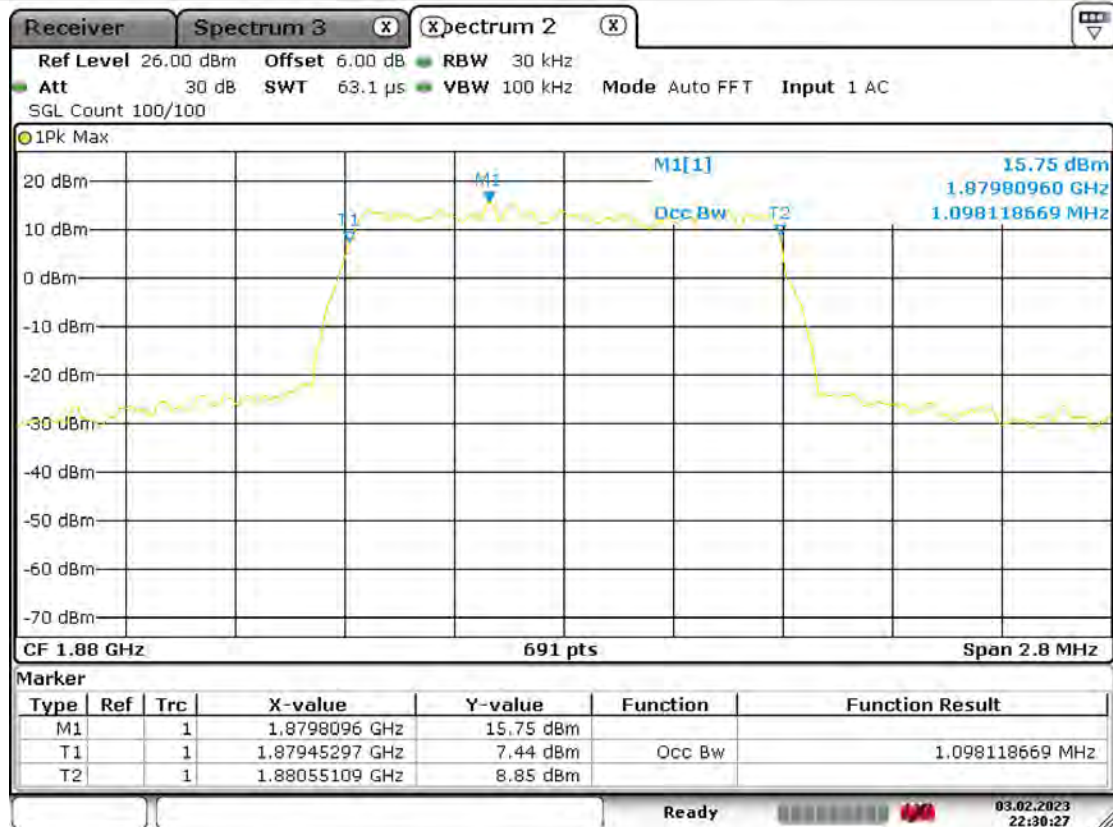


Date: 3.FEB.2023 22:30:27

Band2-1.4MHz-16QAM-19193-6RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

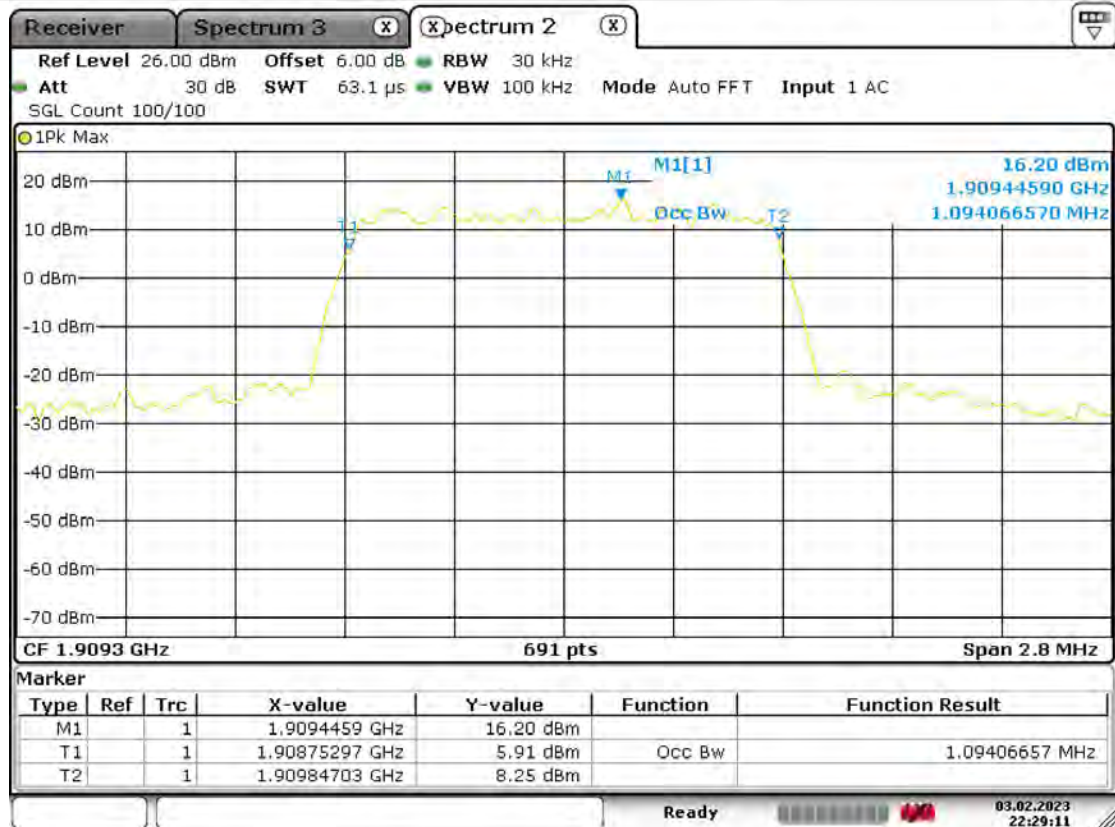


Date: 3.FEB.2023 22:29:11

Band2-3MHz-QPSK-18615-15RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

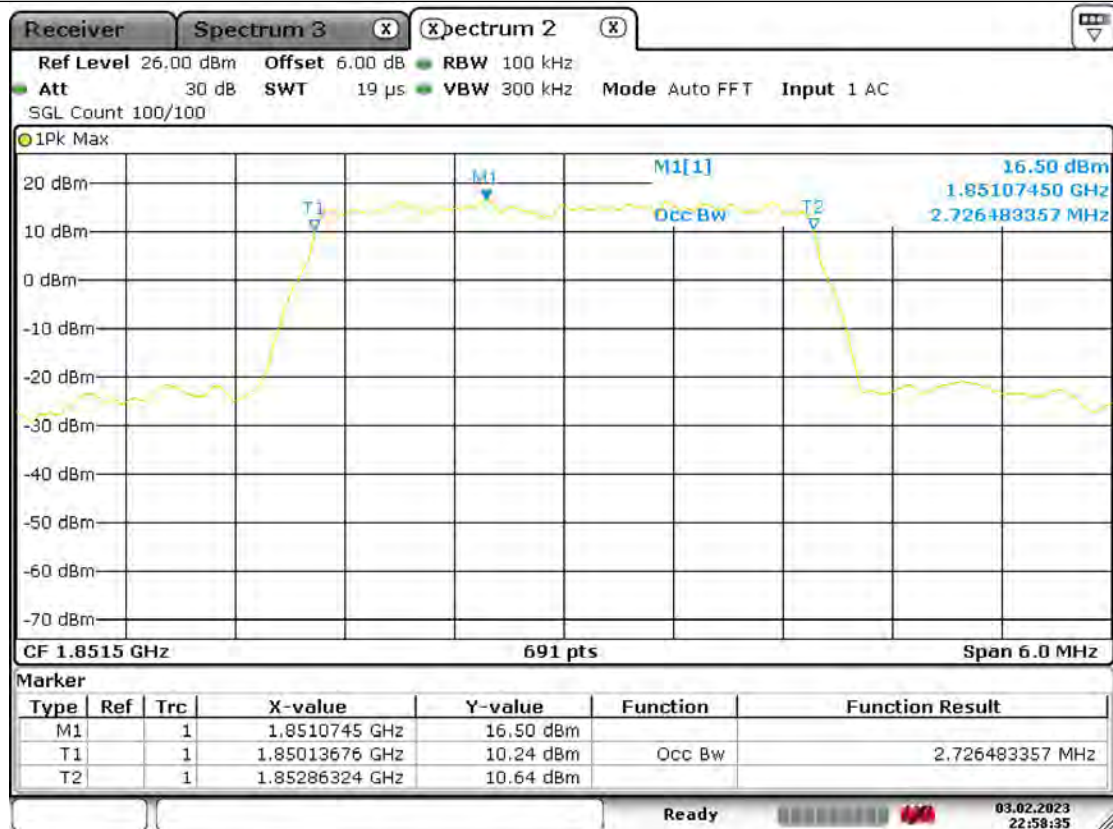


Date: 3.FEB.2023 22:58:34

Band2-3MHz-QPSK-18900-15RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

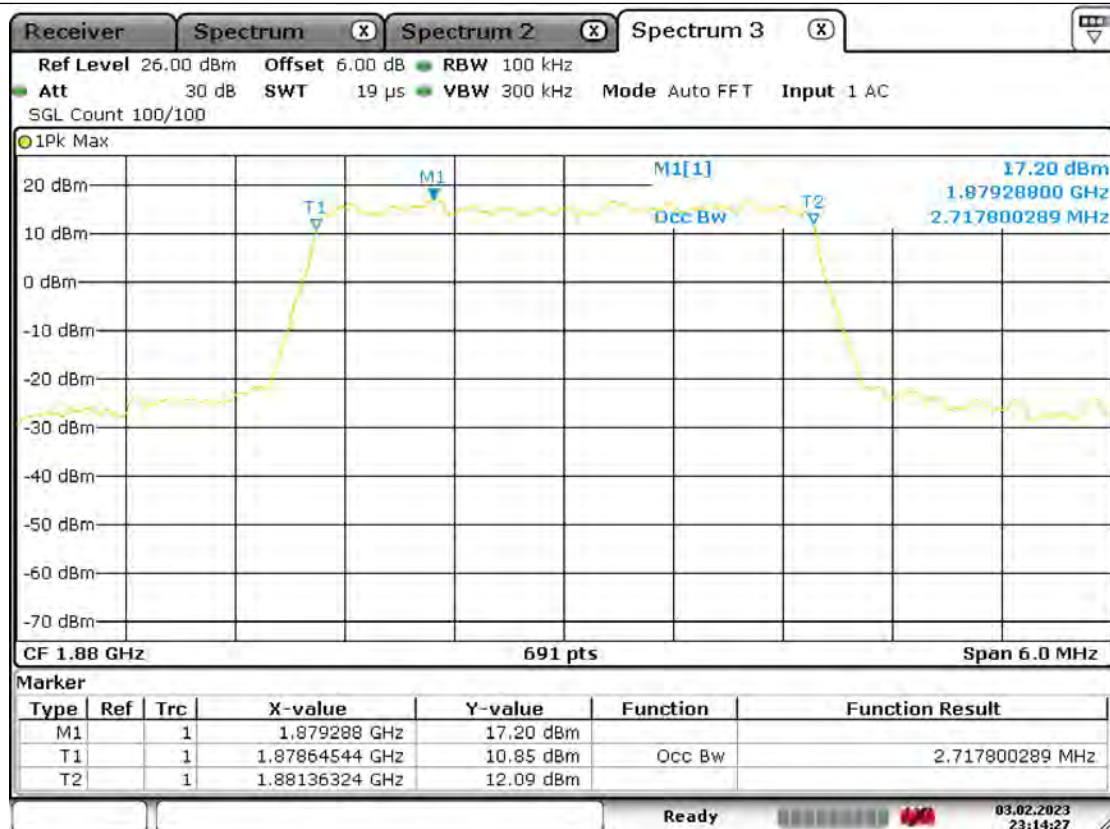


Date: 3.FEB.2023 23:14:27

Band2-3MHz-QPSK-19185-15RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

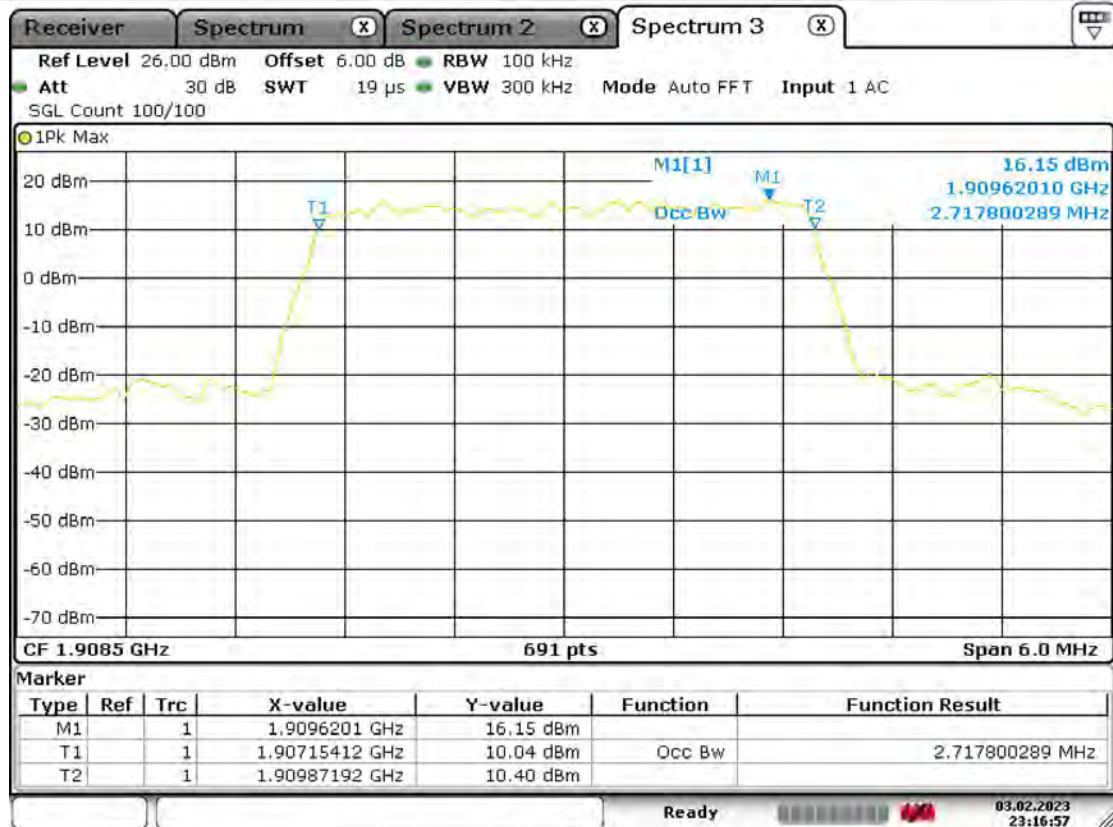


Date: 3.FEB.2023 23:16:57

Band2-3MHz-16QAM-18615-15RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

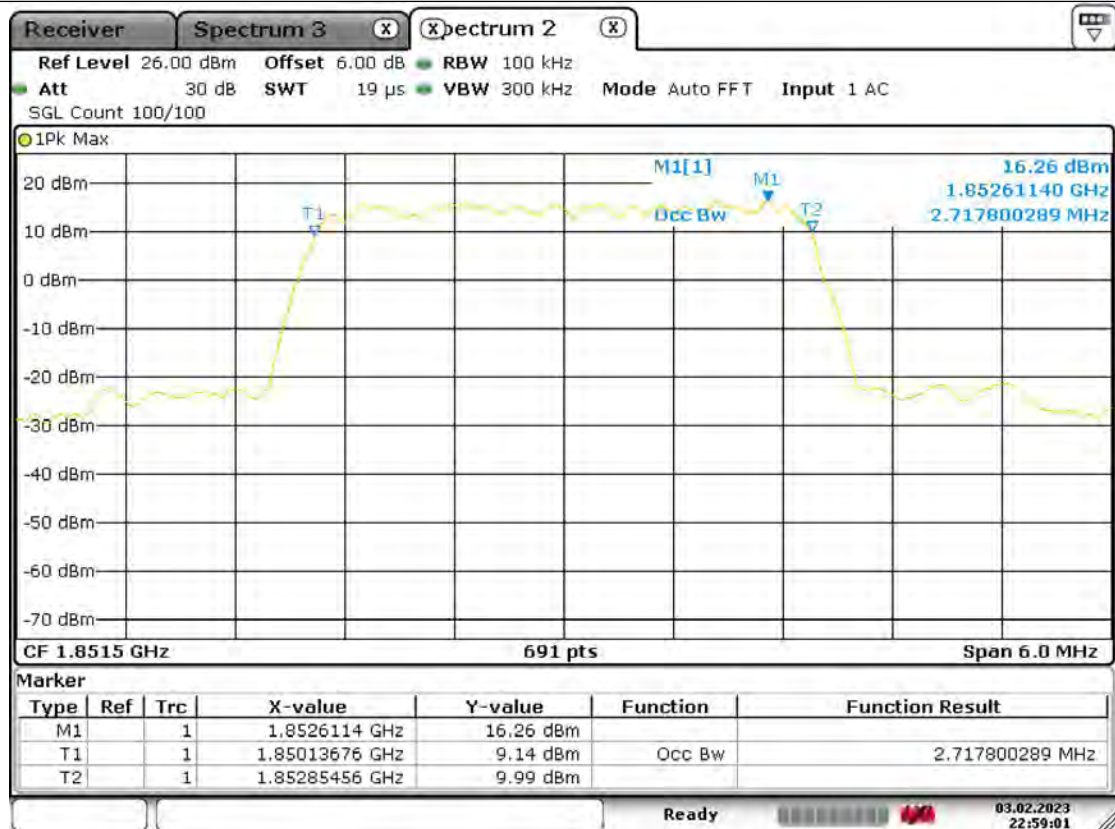


Date: 3.FEB.2023 22:59:01

Band2-3MHz-16QAM-18900-15RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

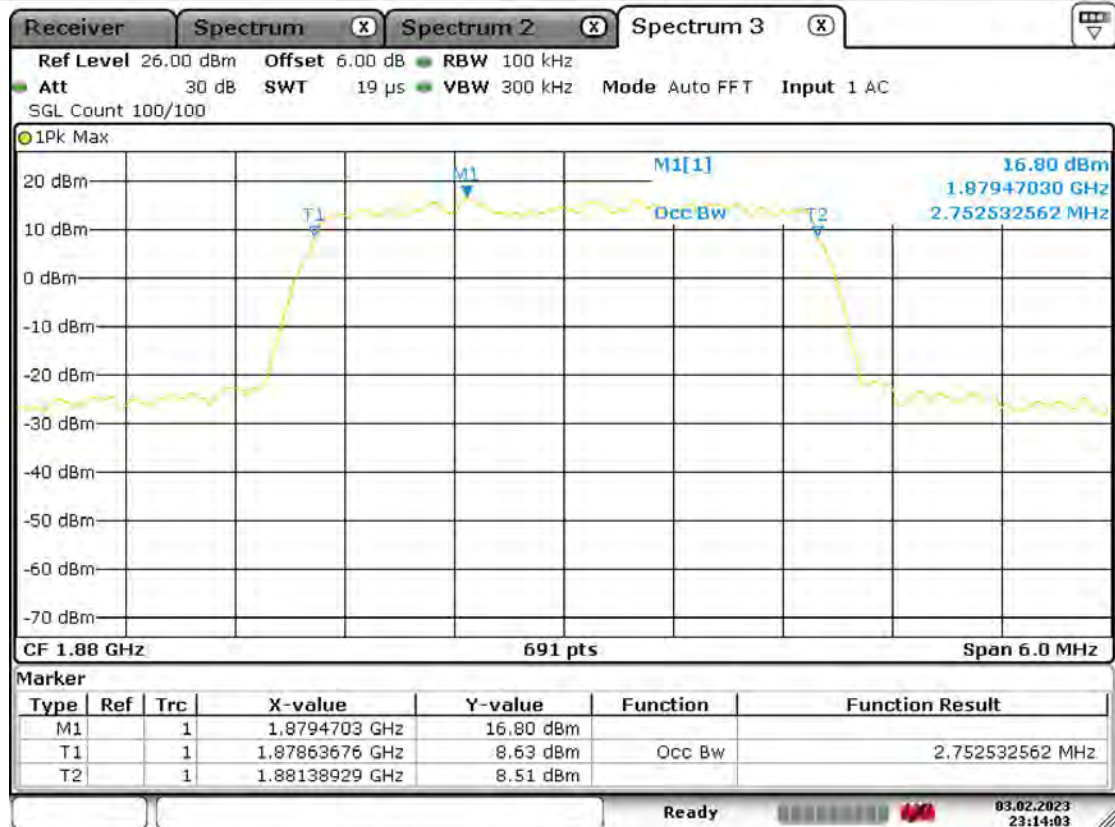


Date: 3.FEB.2023 23:14:03

Band2-3MHz-16QAM-19185-15RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

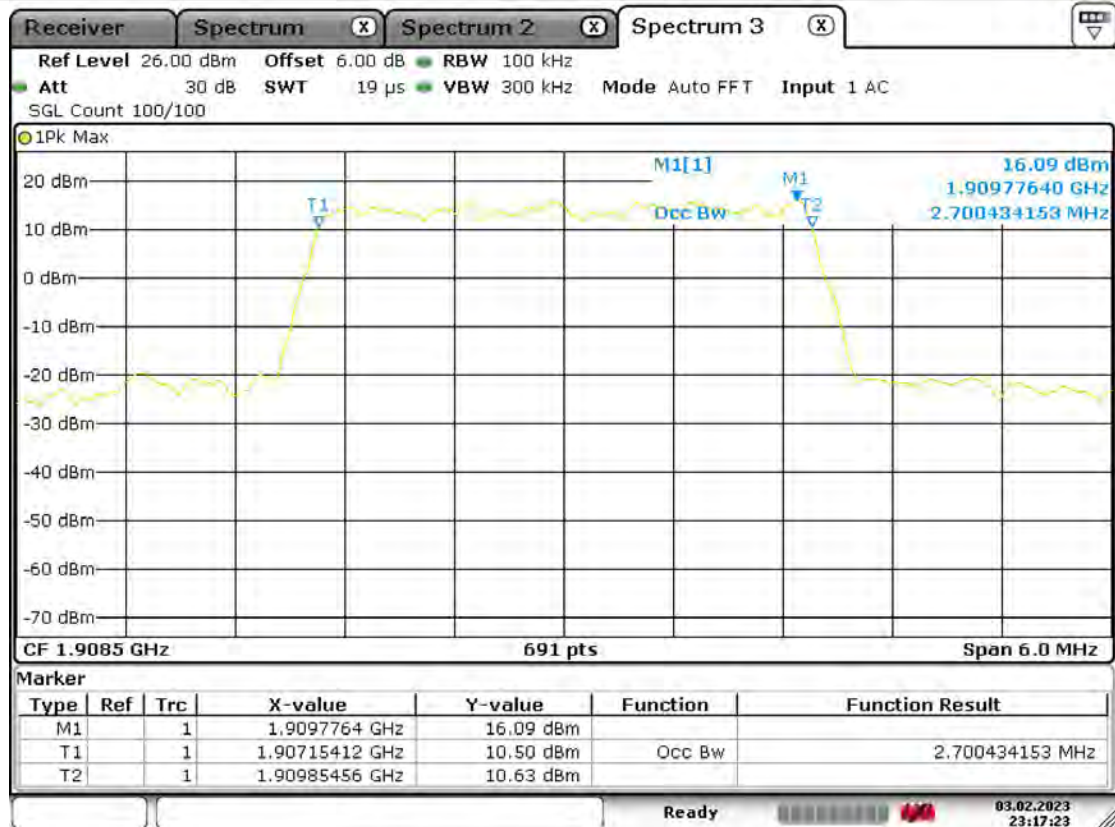


Date: 3.FEB.2023 23:17:23

Band2-5MHz-QPSK-18625-25RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

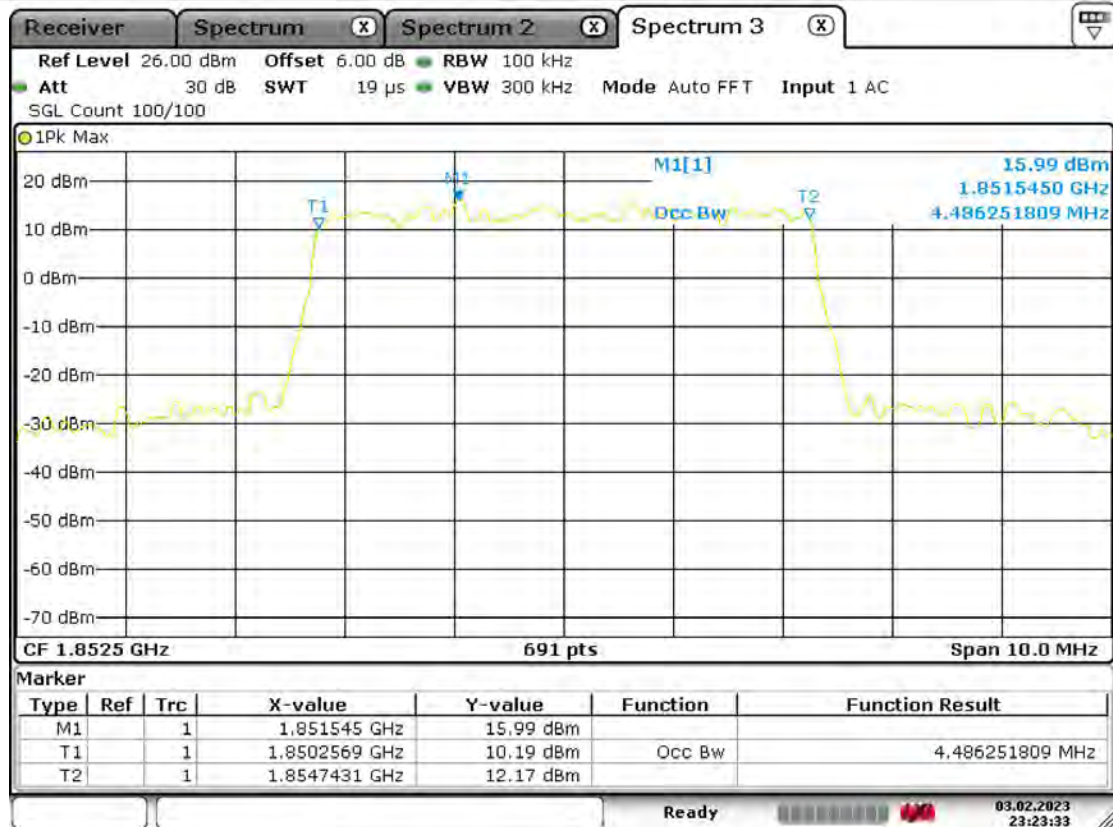


Date: 3.FEB.2023 23:23:33

Band2-5MHz-QPSK-18900-25RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

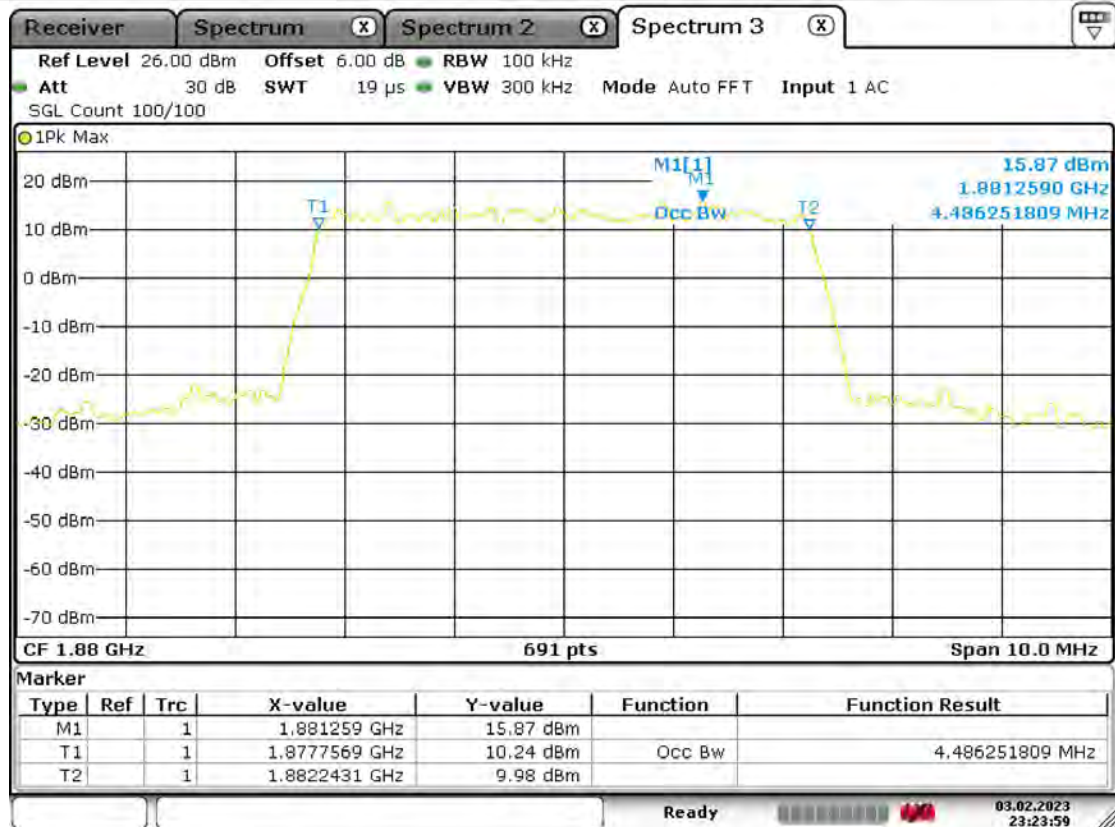


Date: 3.FEB.2023 23:23:59

Band2-5MHz-QPSK-19175-25RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

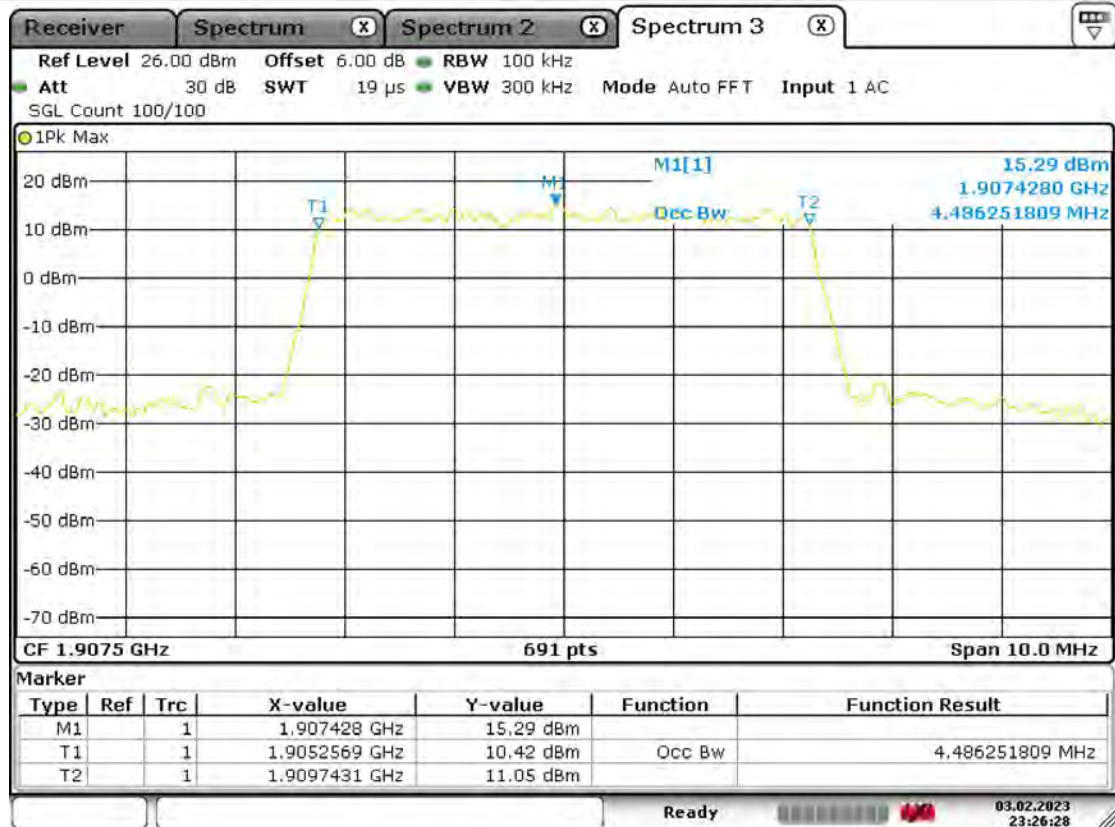


Date: 3.FEB.2023 23:26:28

Band2-5MHz-16QAM-18625-25RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

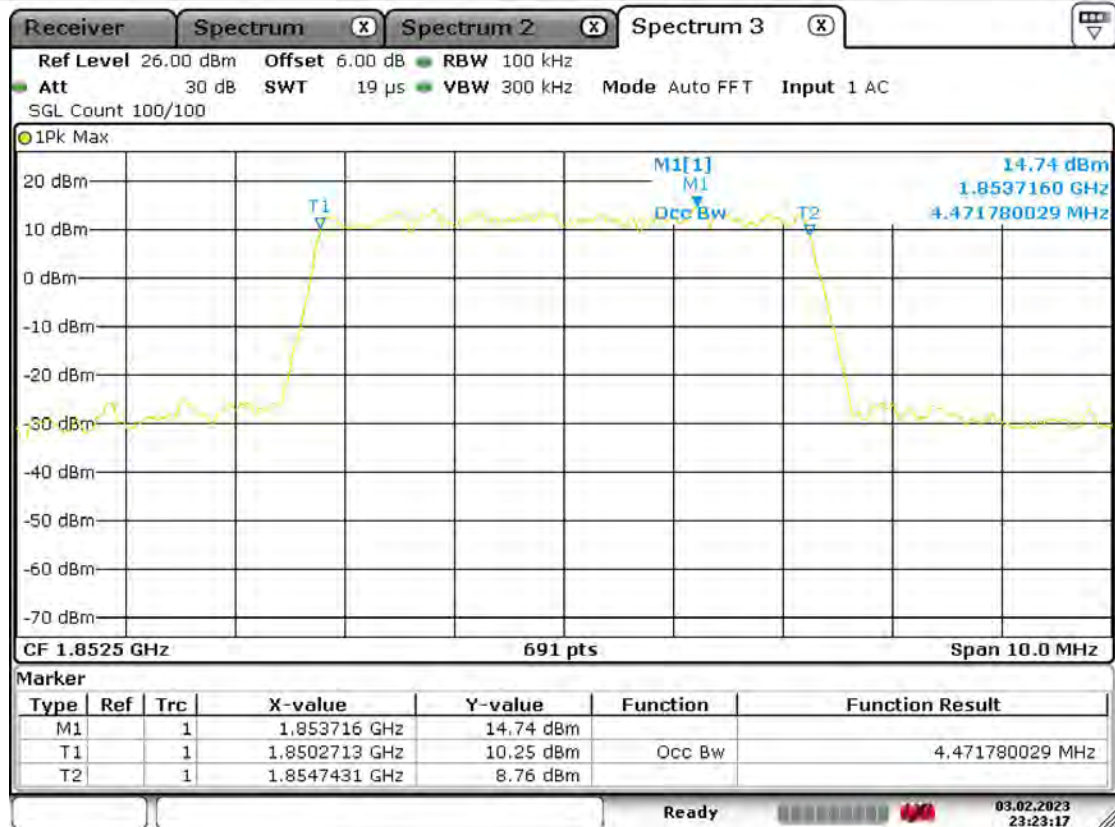


Date: 3.FEB.2023 23:23:17

Band2-5MHz-16QAM-18900-25RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

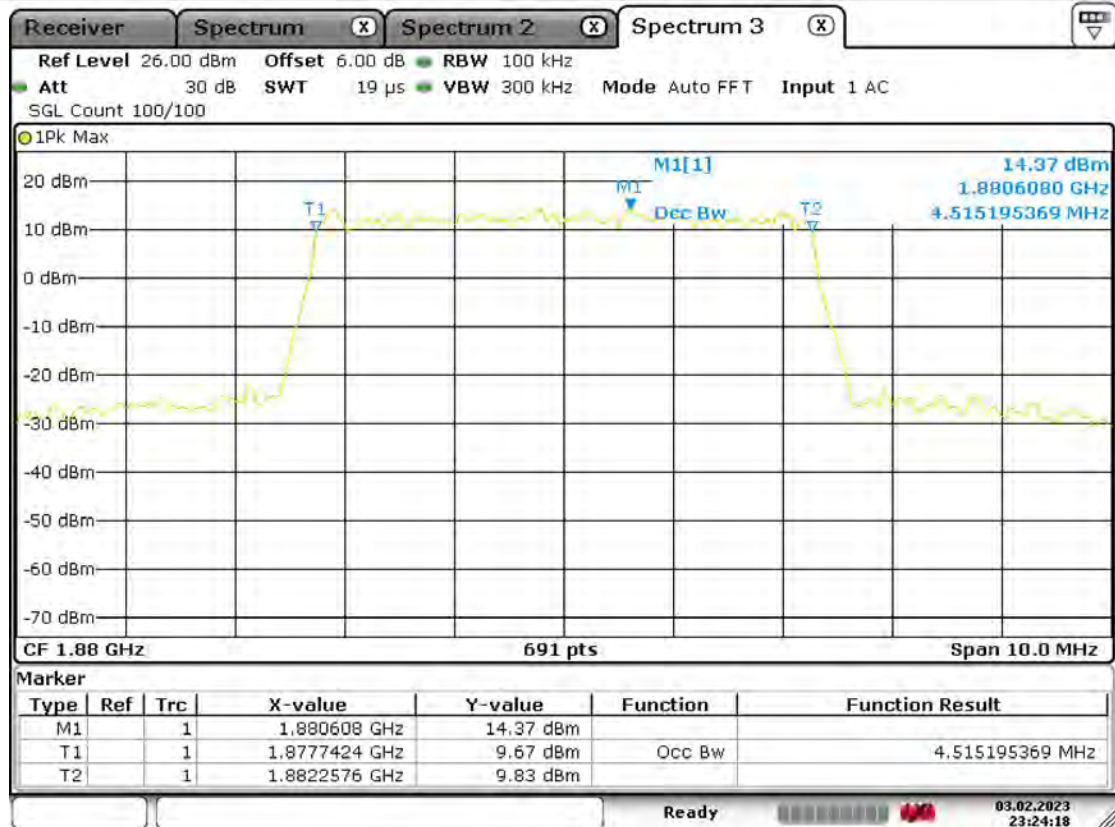


Date: 3.FEB.2023 23:24:18

Band2-5MHz-16QAM-19175-25RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

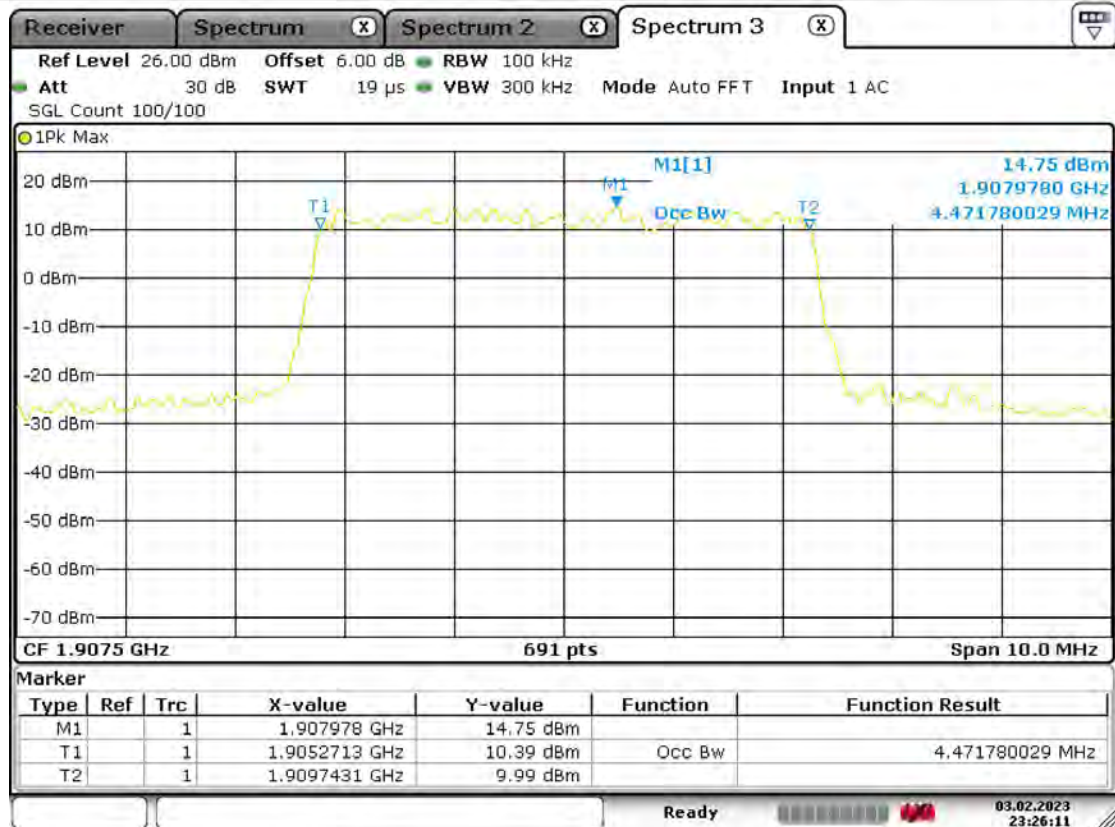


Date: 3.FEB.2023 23:26:10

Band2-10MHz-QPSK-18650-50RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

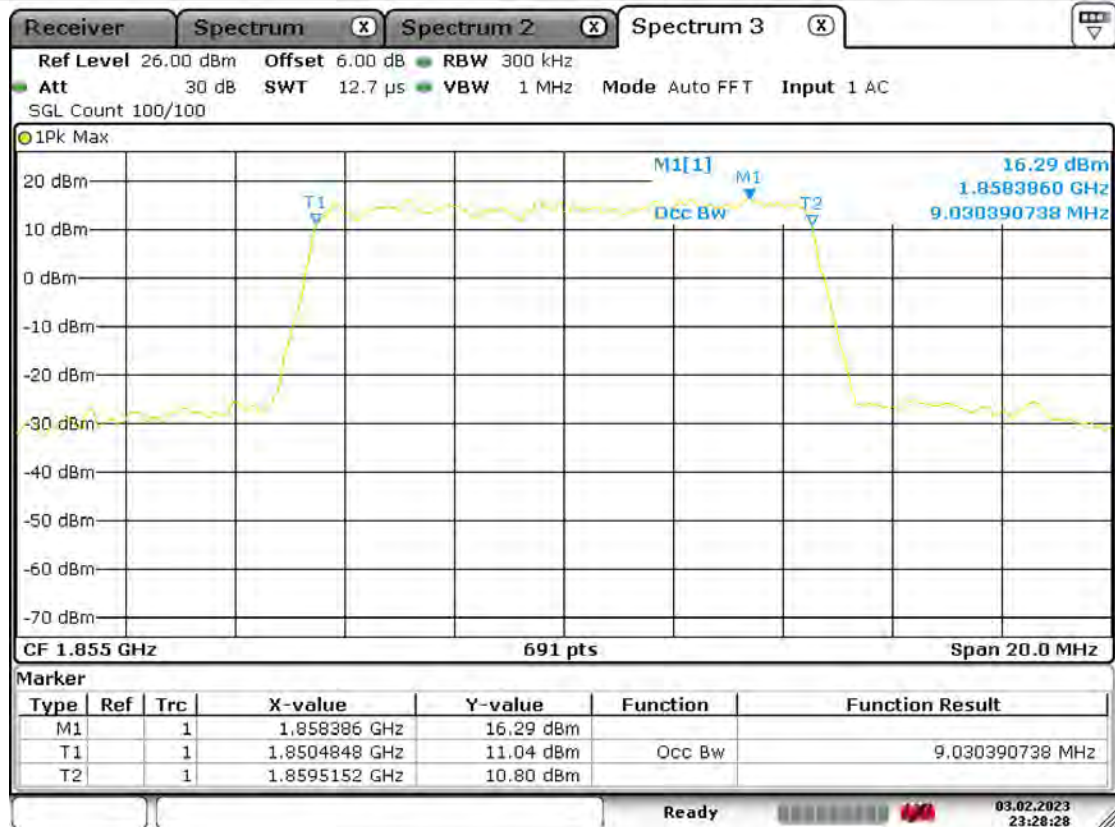


Date: 3.FEB.2023 23:28:27

Band2-10MHz-QPSK-18900-50RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

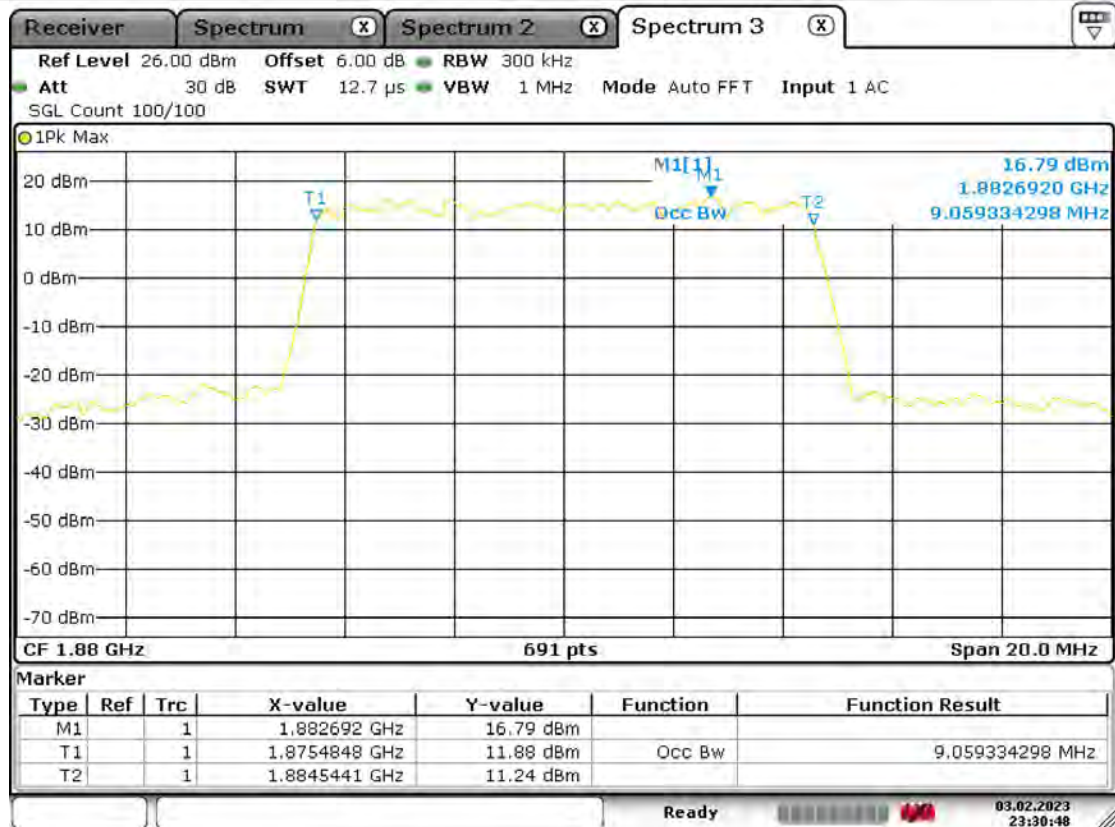


Date: 3.FEB.2023 23:30:48

Band2-10MHz-QPSK-19150-50RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

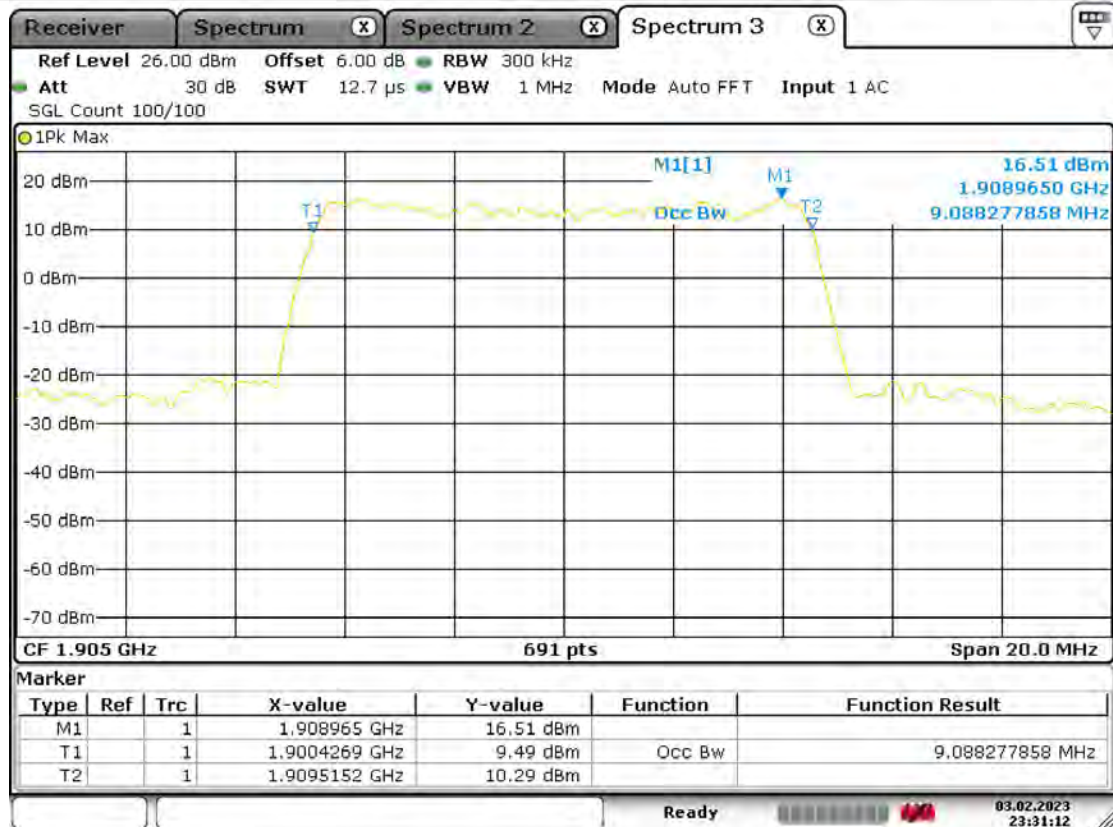


Date: 3.FEB.2023 23:31:11

Band2-10MHz-16QAM-18650-50RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

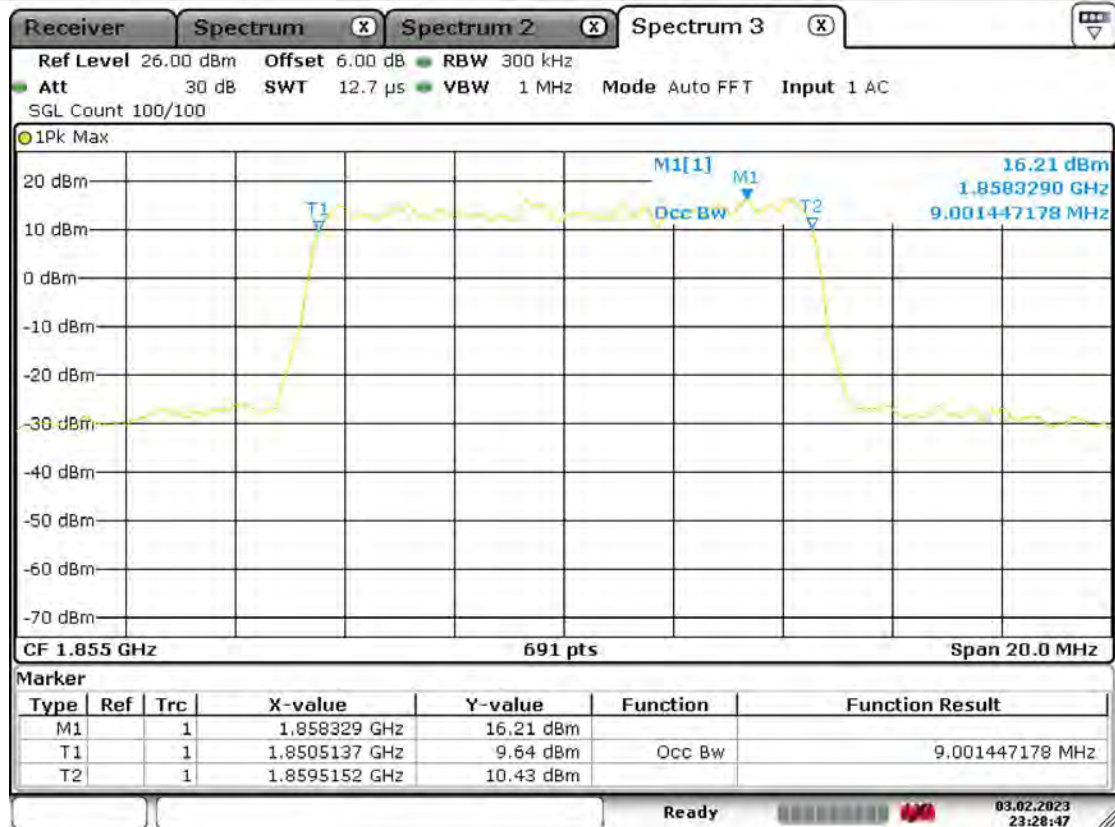


Date: 3.FEB.2023 23:28:47

Band2-10MHz-16QAM-18900-50RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

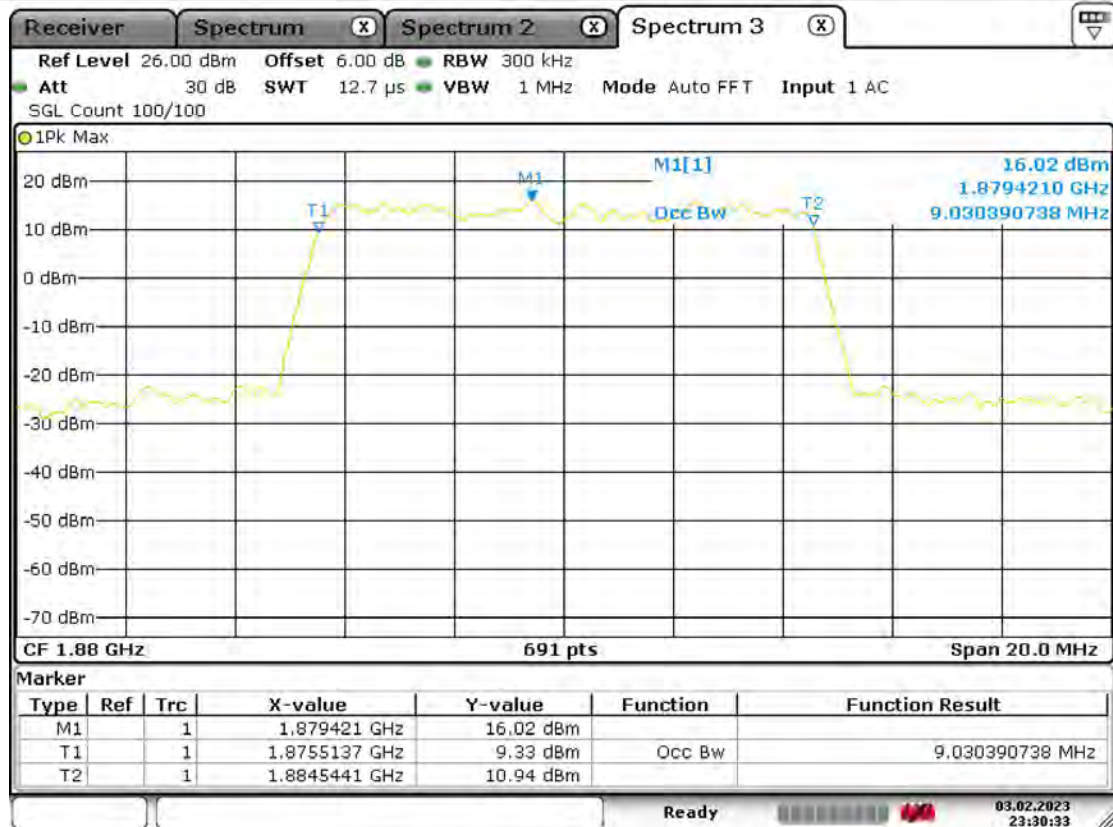


Date: 3.FEB.2023 23:30:33

Band2-10MHz-16QAM-19150-50RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

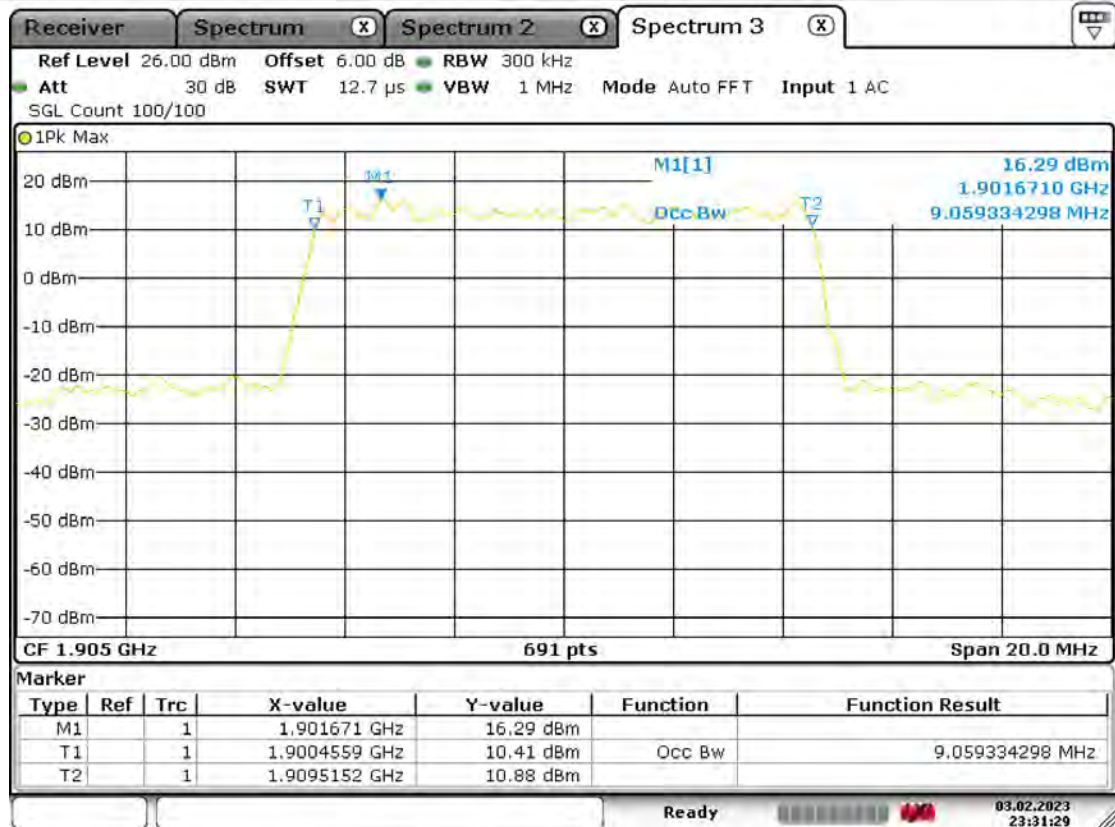


Date: 3.FEB.2023 23:31:29

Band2-15MHz-QPSK-18675-75RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

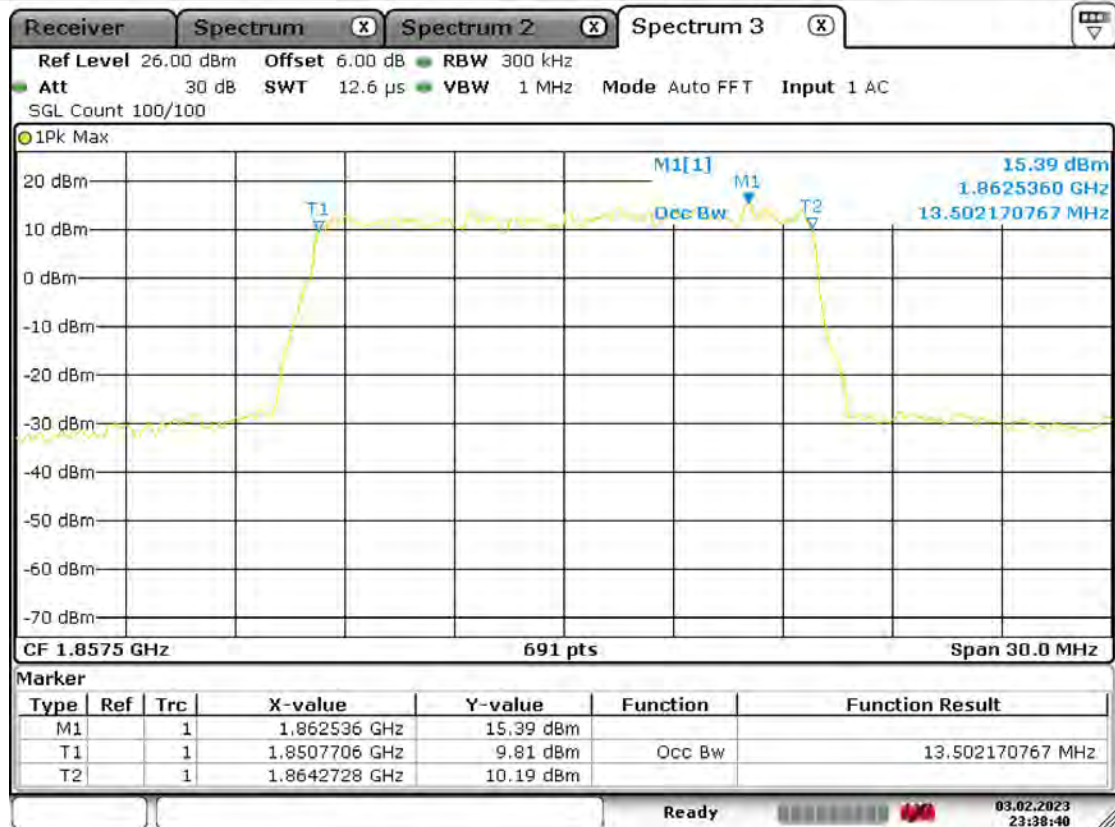


Date: 3.FEB.2023 23:38:40

Band2-15MHz-QPSK-18900-75RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

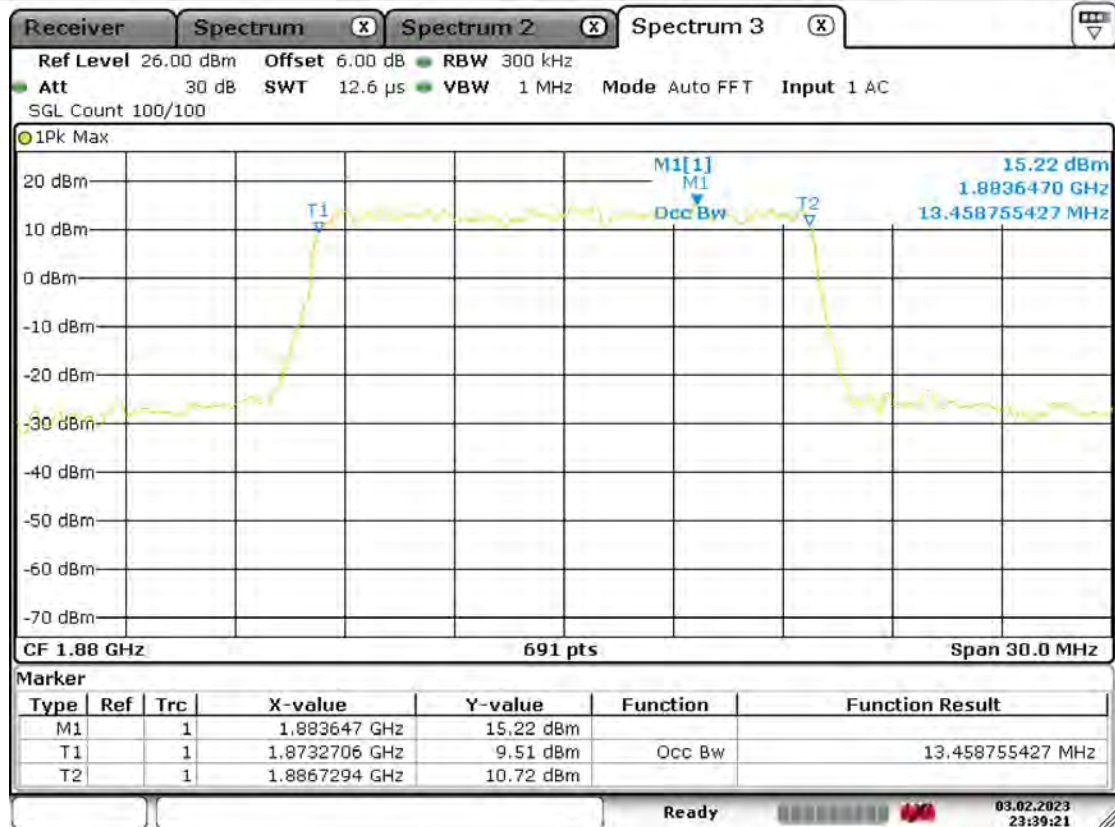


Date: 3.FEB.2023 23:39:21

Band2-15MHz-QPSK-19125-75RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

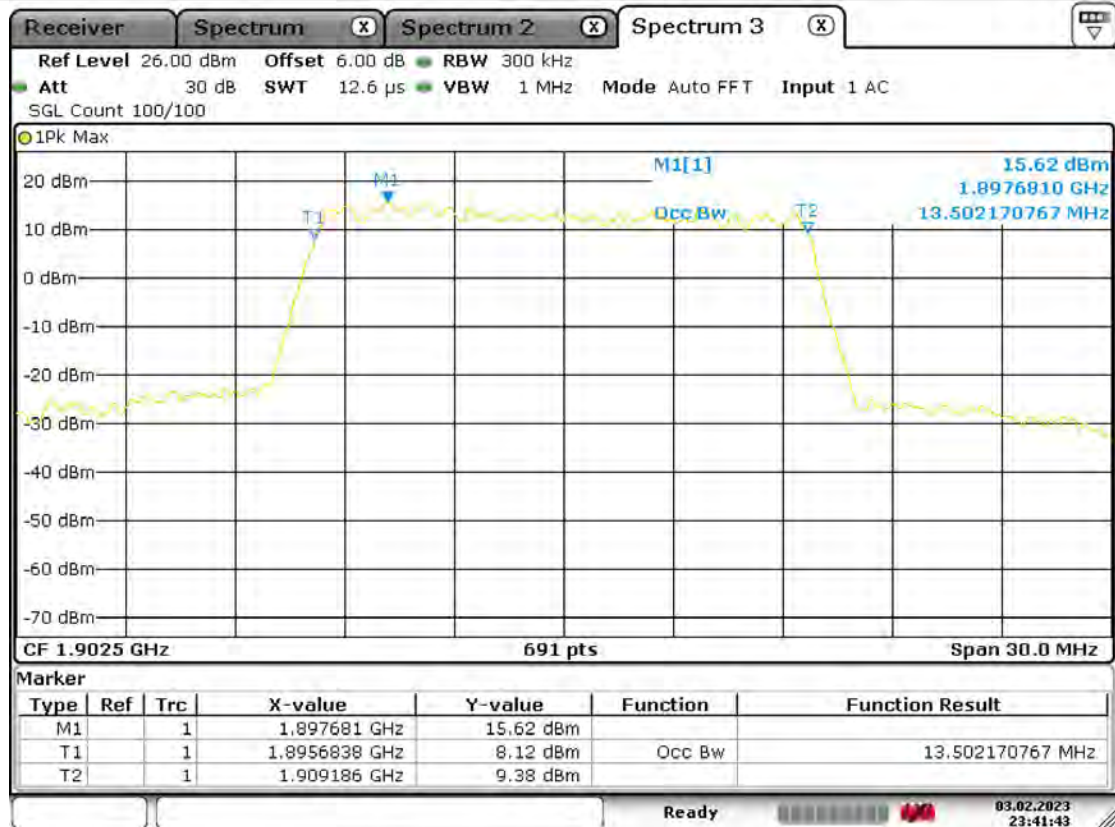


Date: 3.FEB.2023 23:41:43

Band2-15MHz-16QAM-18675-75RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

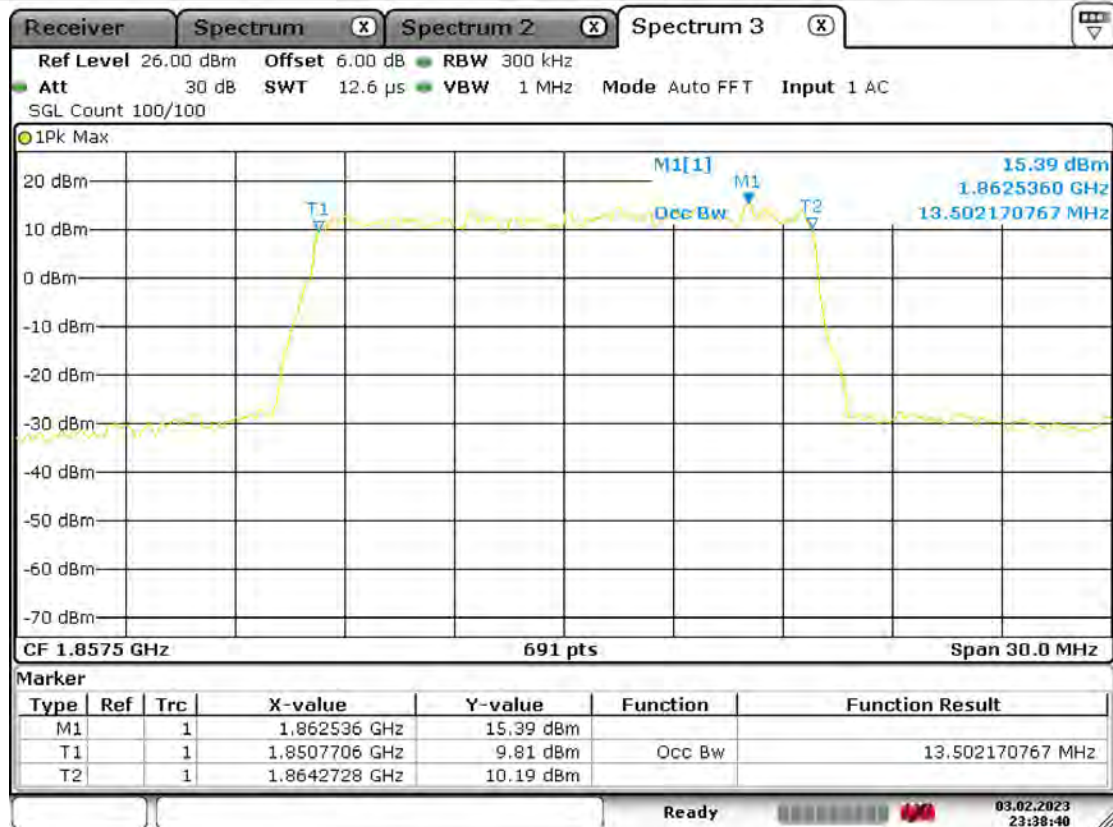


Date: 3.FEB.2023 23:38:40

Band2-15MHz-16QAM-18900-75RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

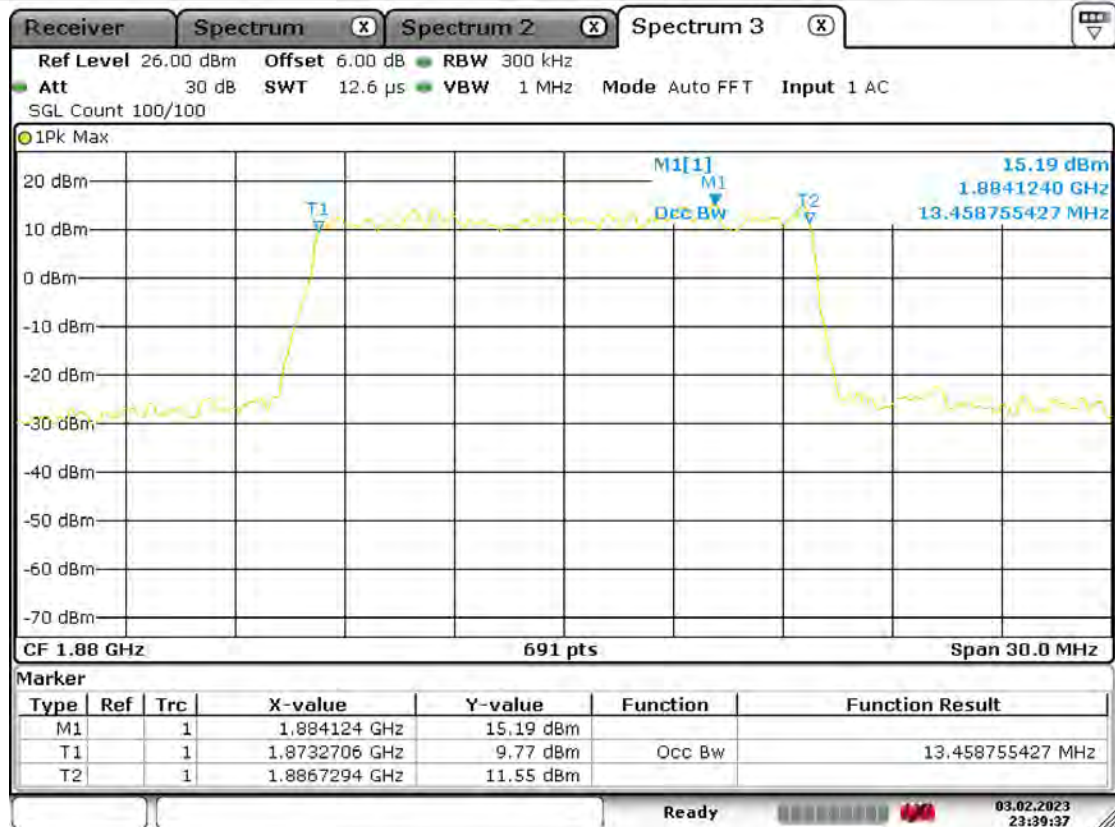


Date: 3.FEB.2023 23:39:37

Band2-15MHz-16QAM-19125-75RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

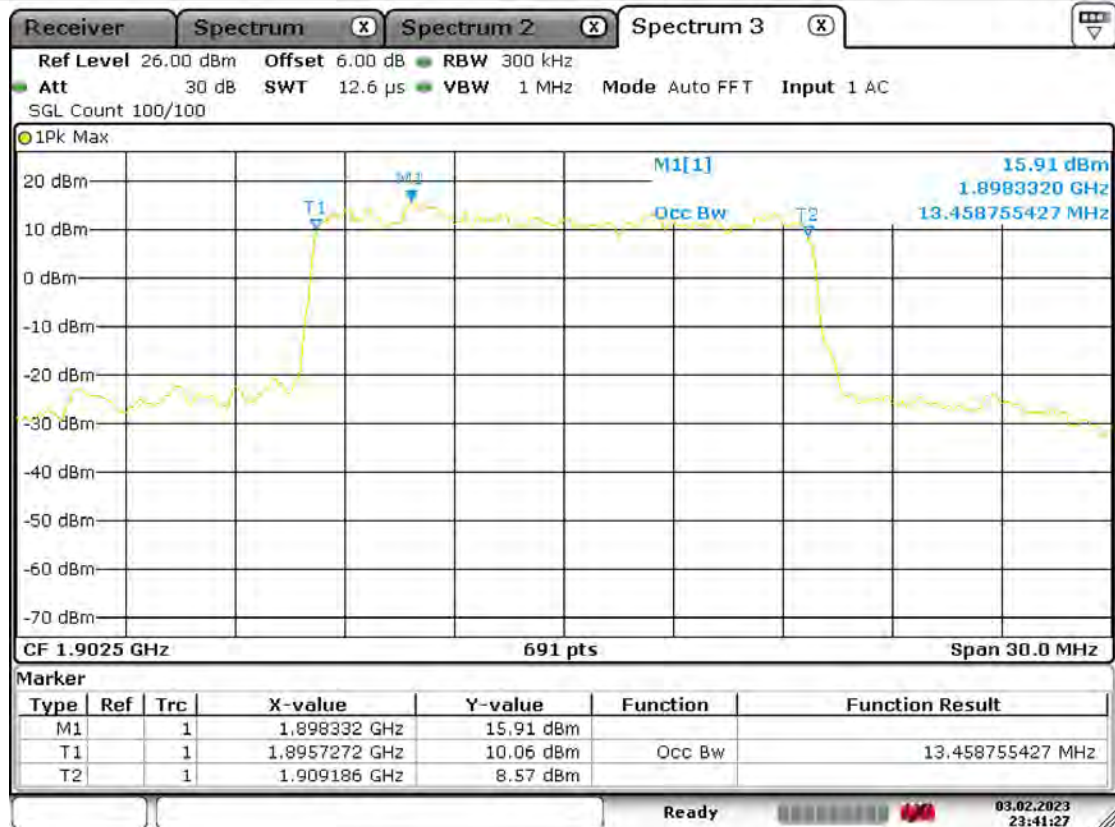


Date: 3.FEB.2023 23:41:27

Band2-20MHz-QPSK-18700-100RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

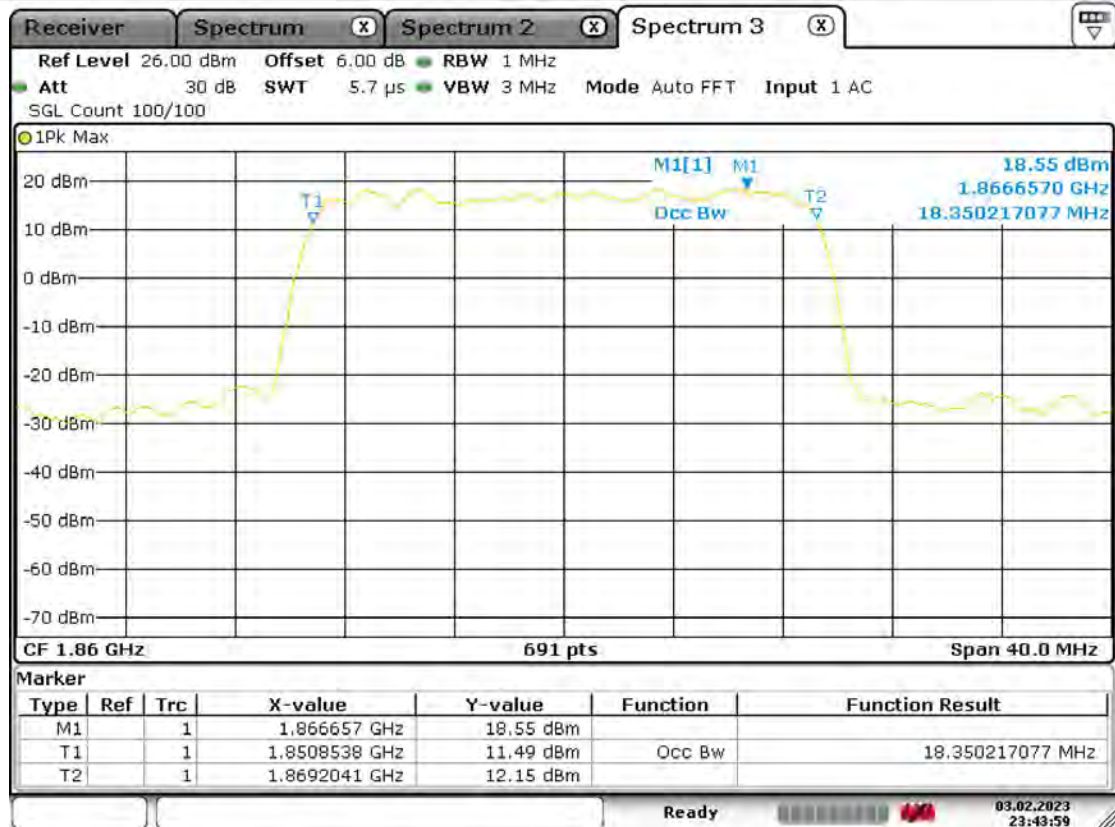


Date: 3.FEB.2023 23:43:59

Band2-20MHz-QPSK-18900-100RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

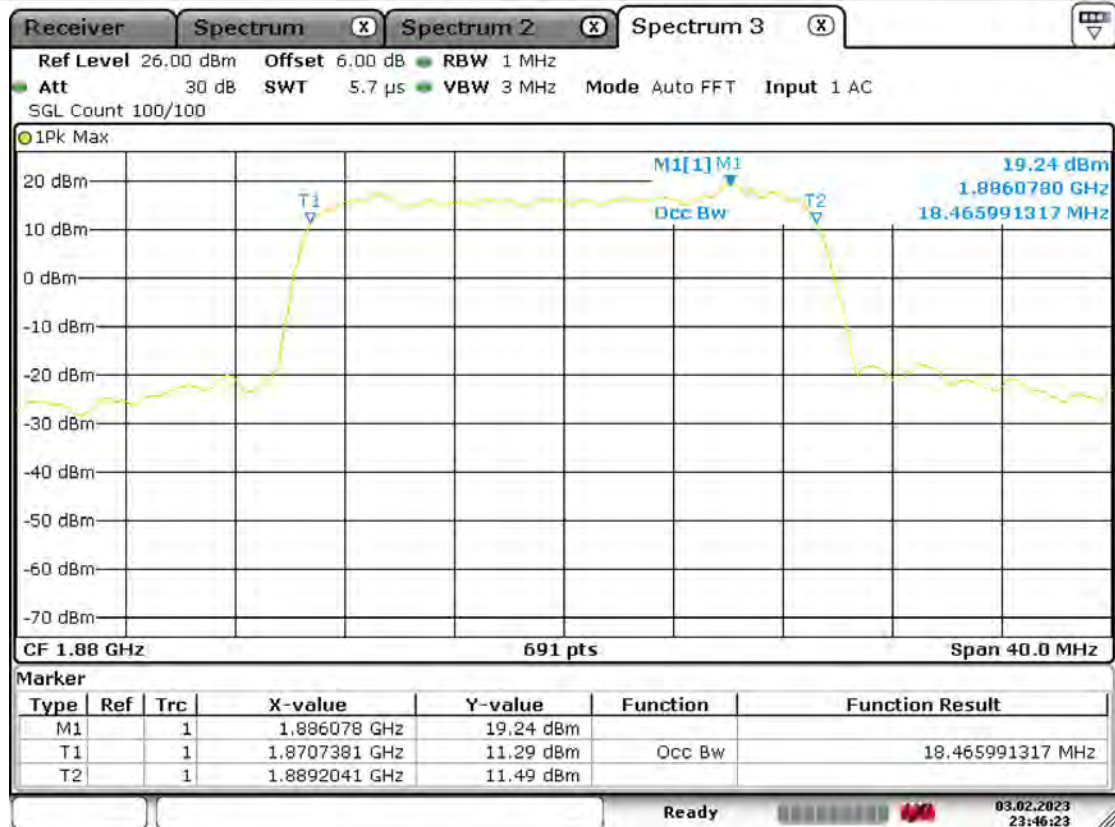


Date: 3.FEB.2023 23:46:23

Band2-20MHz-QPSK-19100-100RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

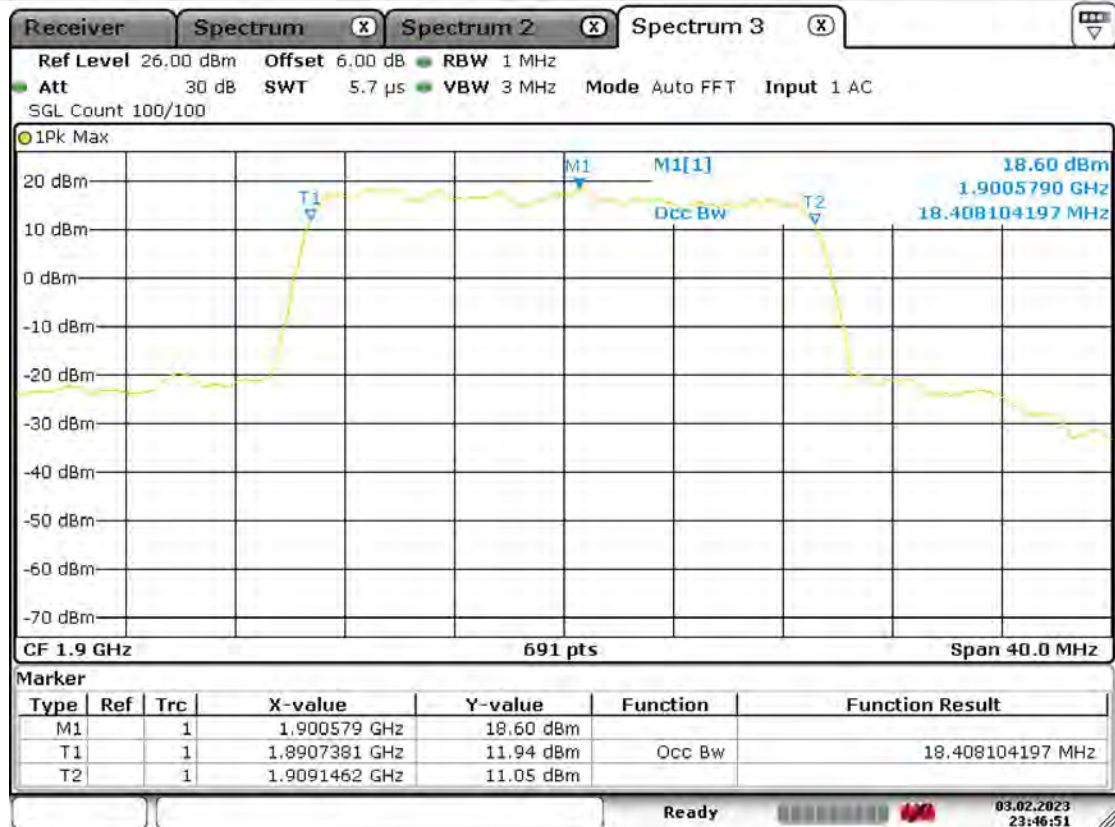


Date: 3.FEB.2023 23:46:51

Band2-20MHz-16QAM-18700-100RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

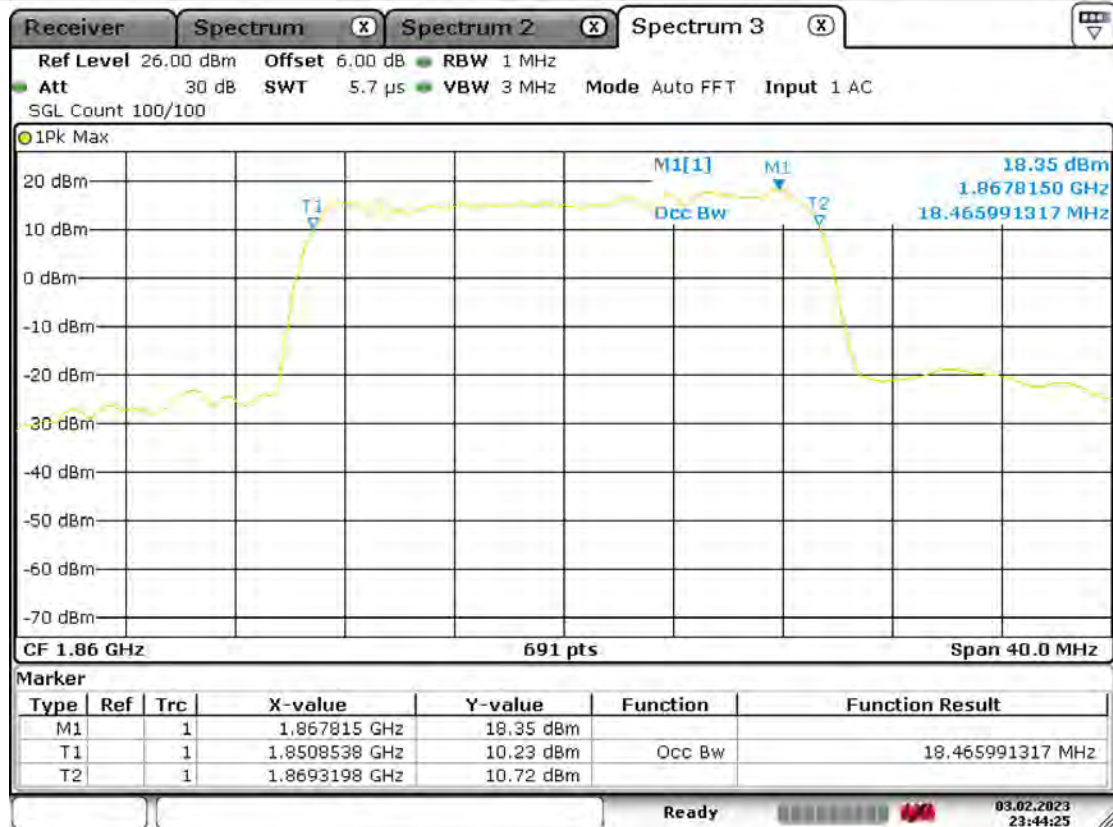


Date: 3.FEB.2023 23:44:25

Band2-20MHz-16QAM-18900-100RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

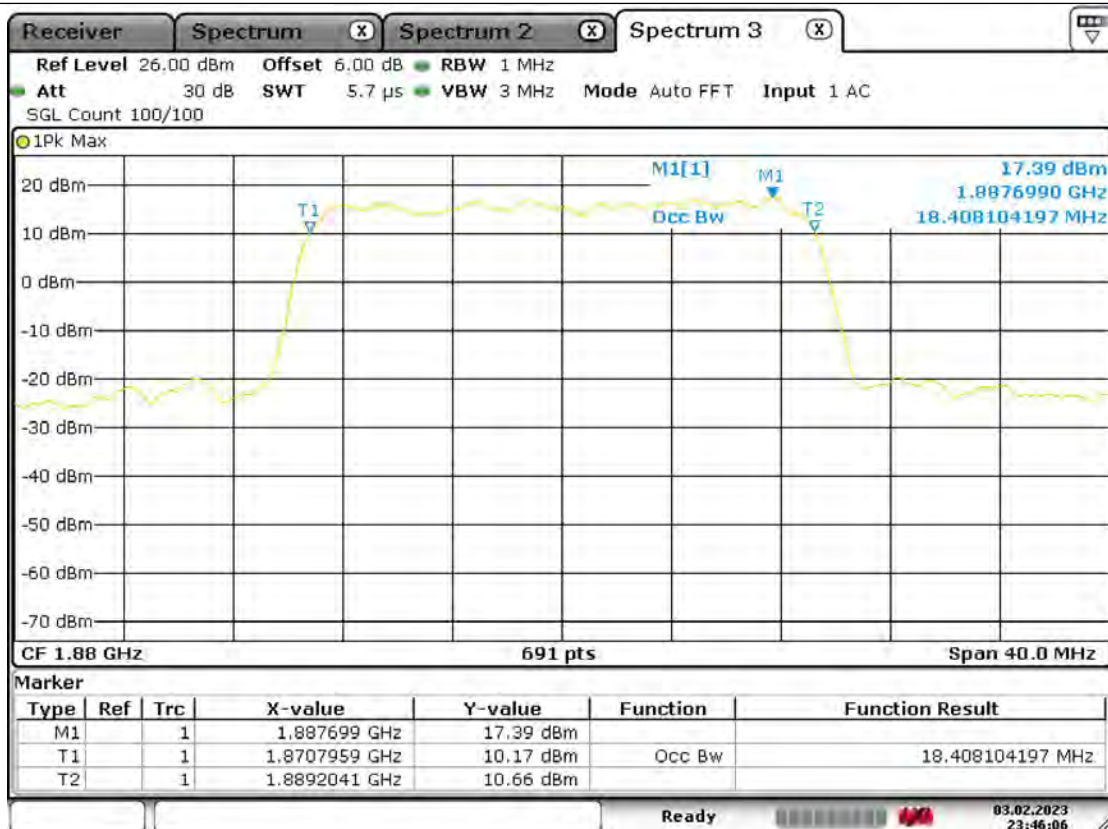


Date: 3.FEB.2023 23:46:05

Band2-20MHz-16QAM-19100-100RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

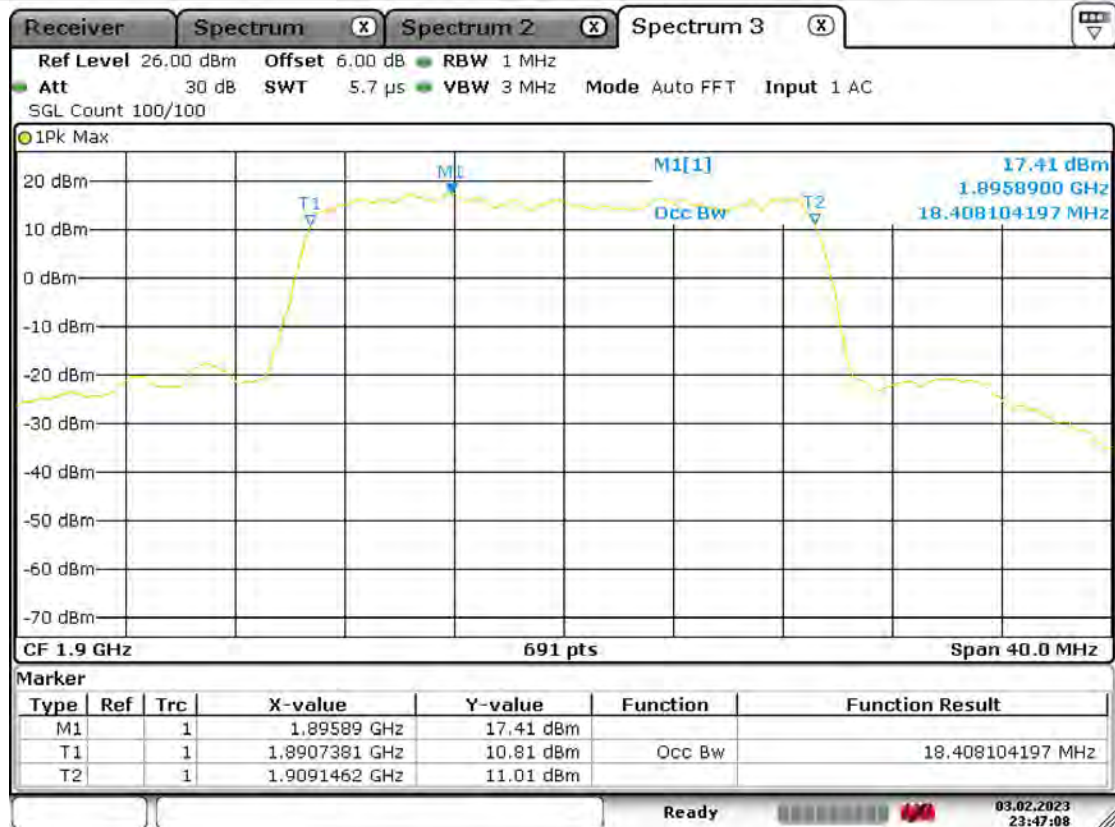


Date: 3.FEB.2023 23:47:08

Band2-1.4MHz-64QPSK-18607-6RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

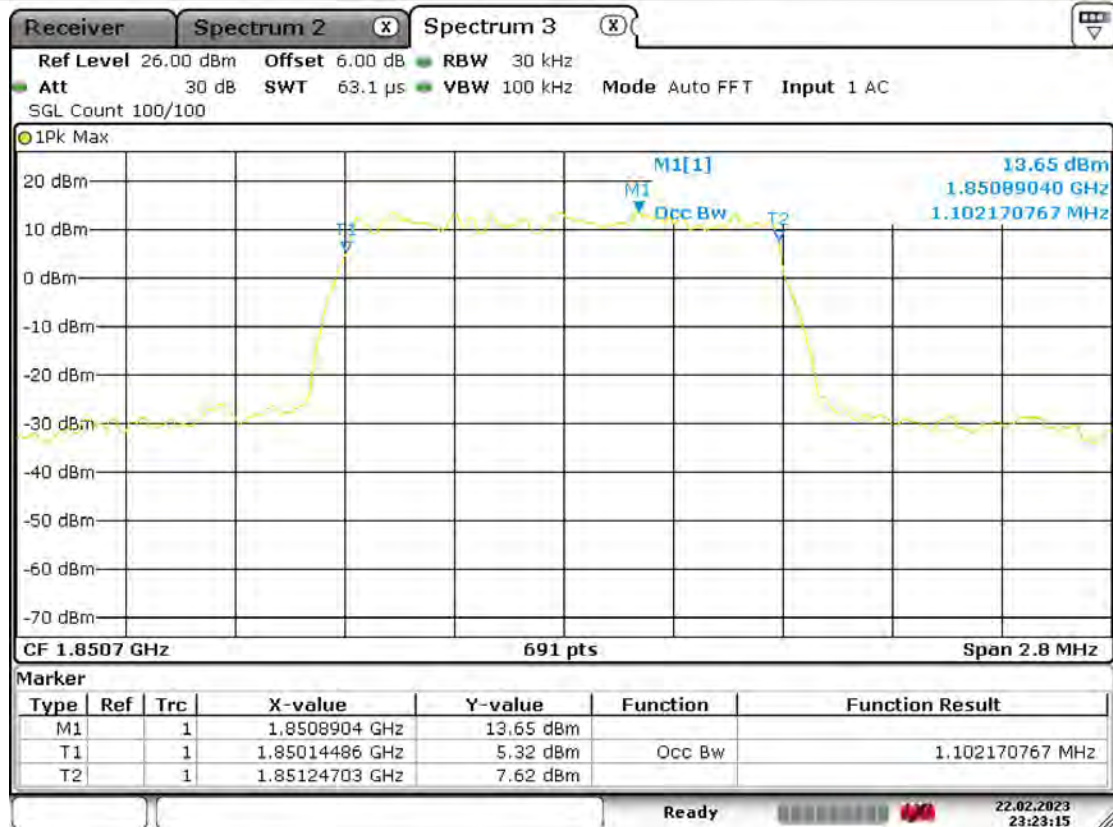


Date: 22.FEB.2023 23:23:15

Band2-1.4MHz-64QPSK-18900-6RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

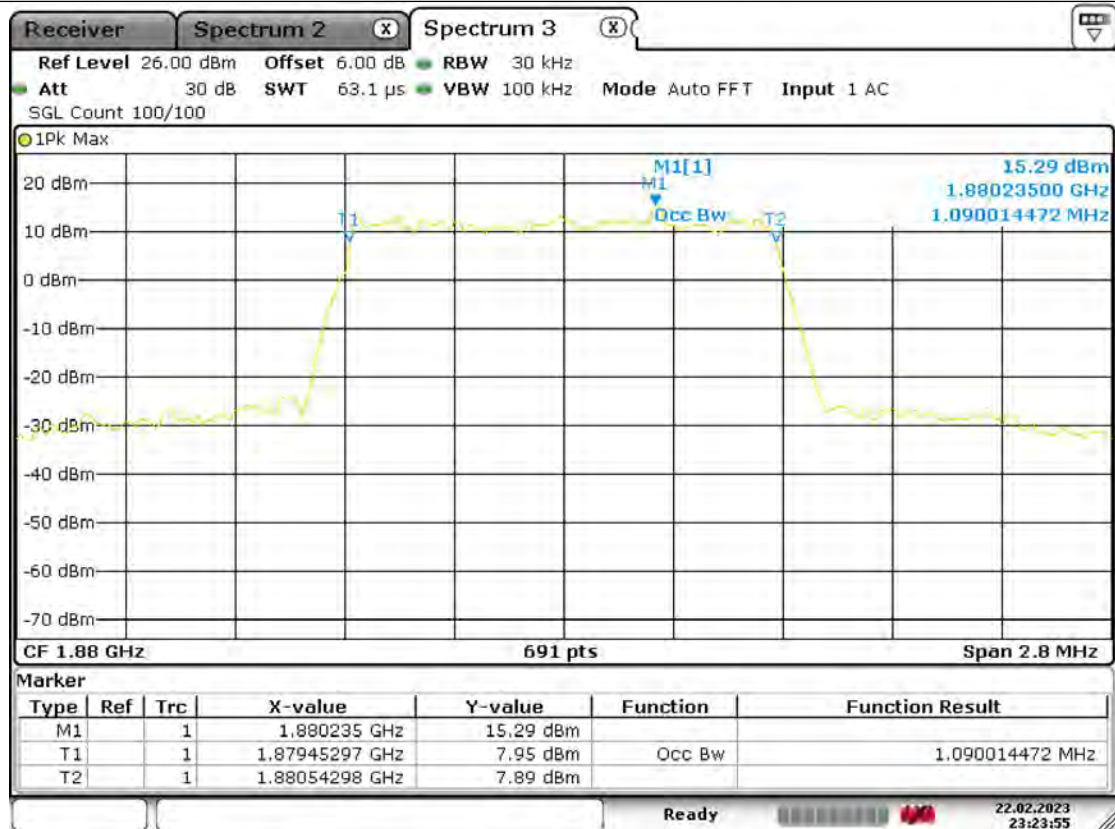


Date: 22.FEB.2023 23:23:55

Band2-1.4MHz-64QPSK-19193-6RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

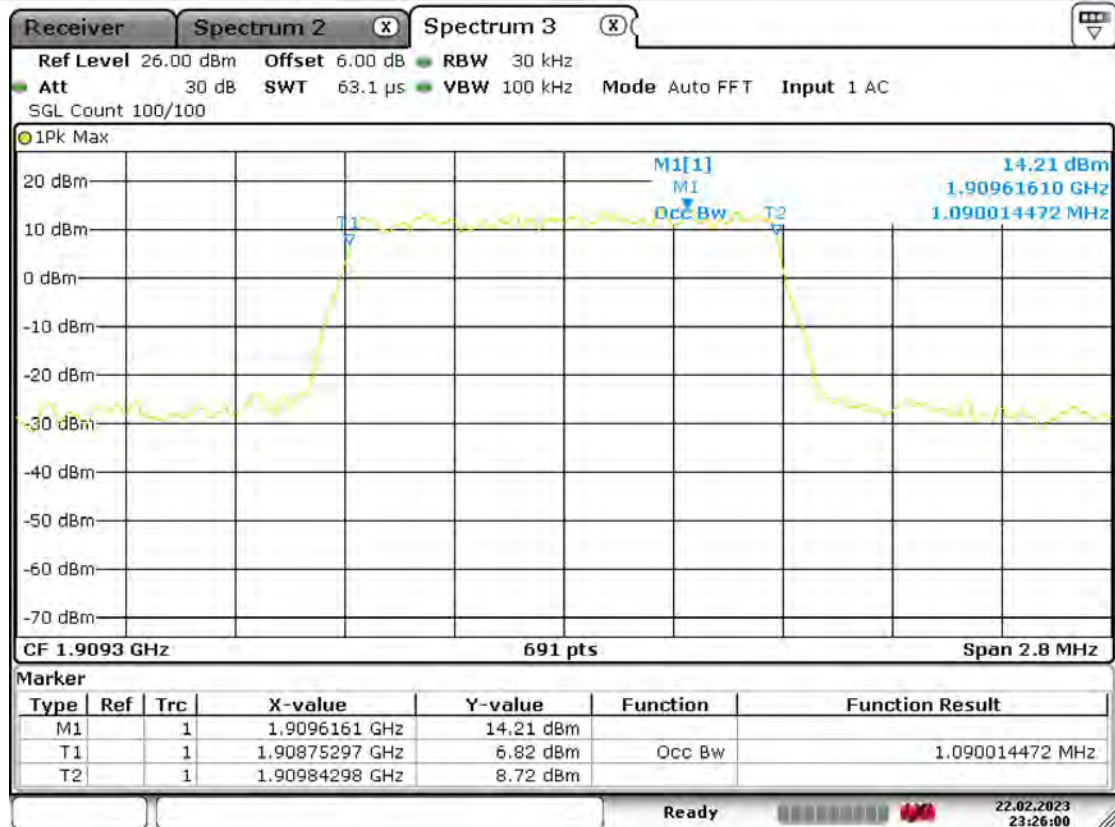


Date: 22.FEB.2023 23:26:00

Band2-3MHz-64QPSK-18615-6RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

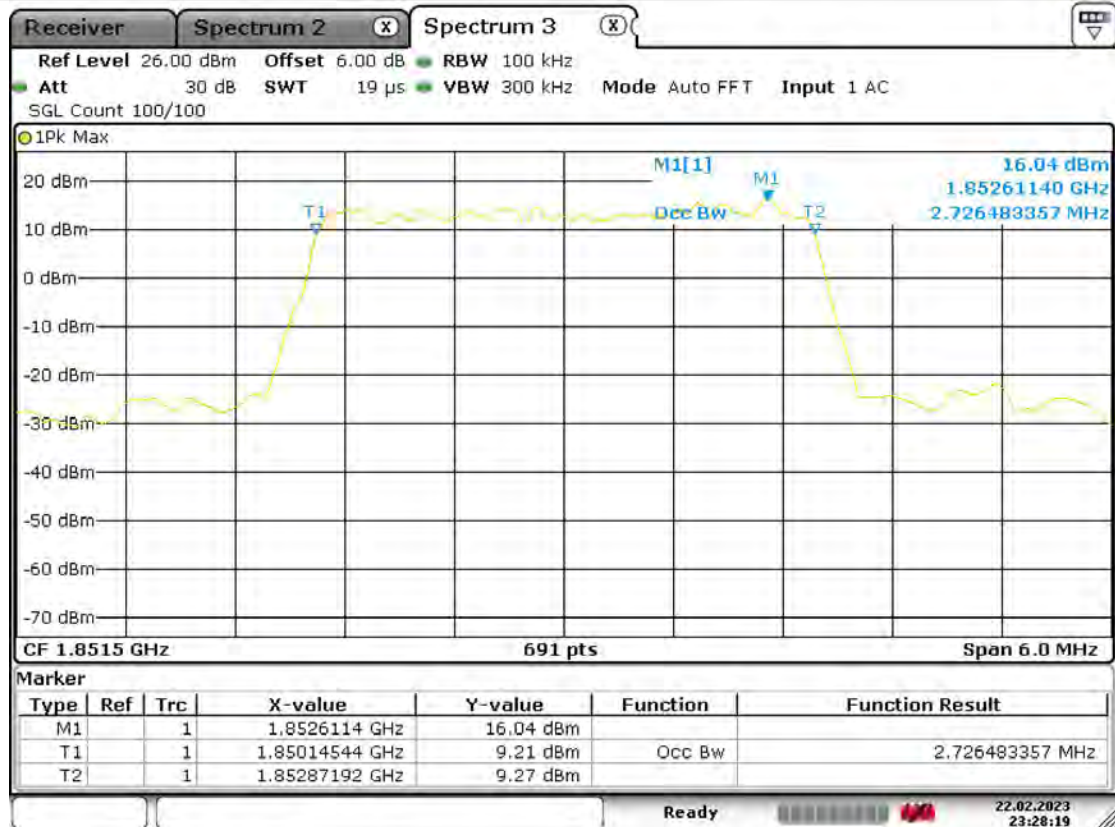


Date: 22.FEB.2023 23:28:19

Band2-3MHz-64QPSK-18900-6RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

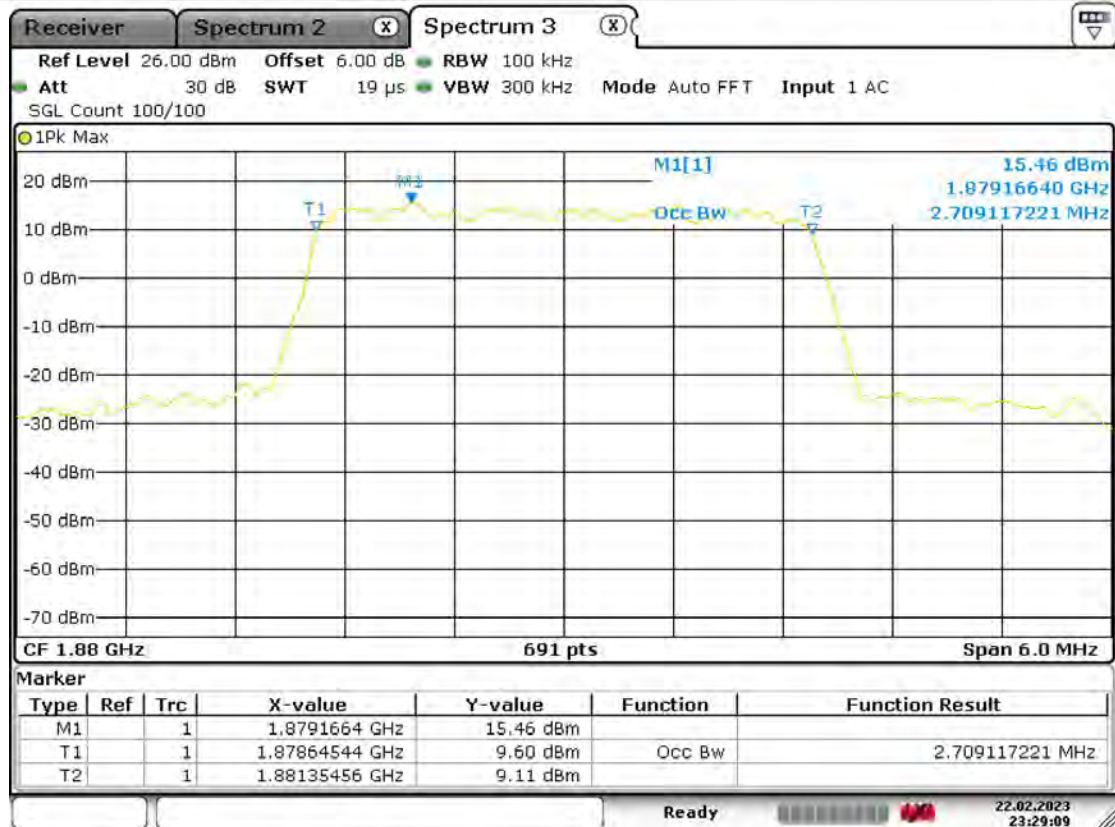


Date: 22.FEB.2023 23:29:09

Band2-3MHz-64QPSK-19185-6RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

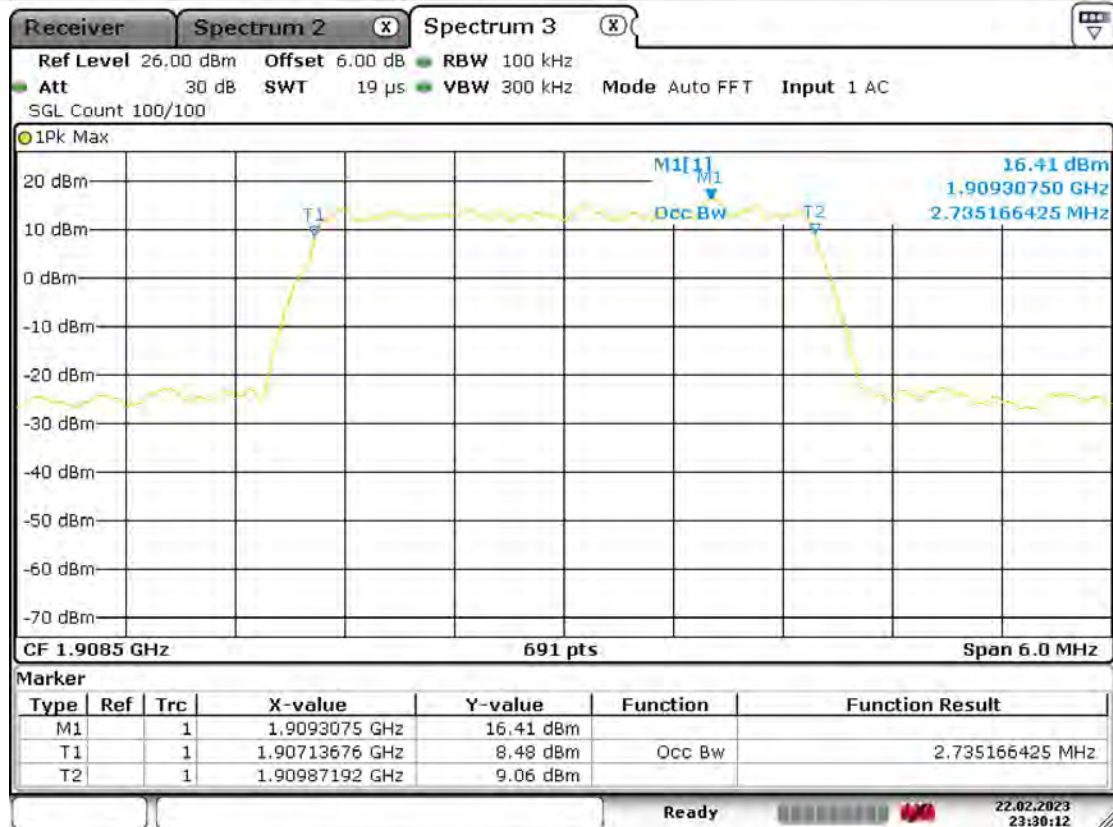


Date: 22.FEB.2023 23:30:12

Band2-5MHz-64QPSK-18625-6RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

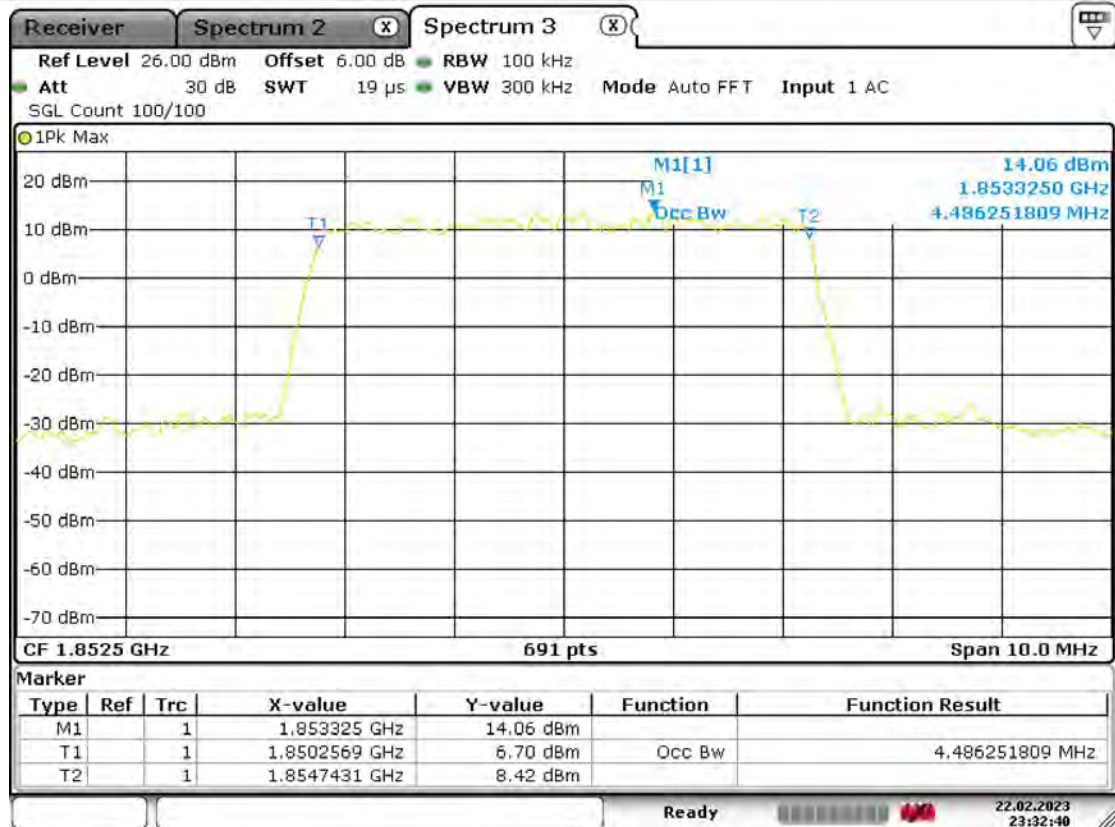


Date: 22.FEB.2023 23:32:40

Band2-5MHz-64QPSK-18900-6RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

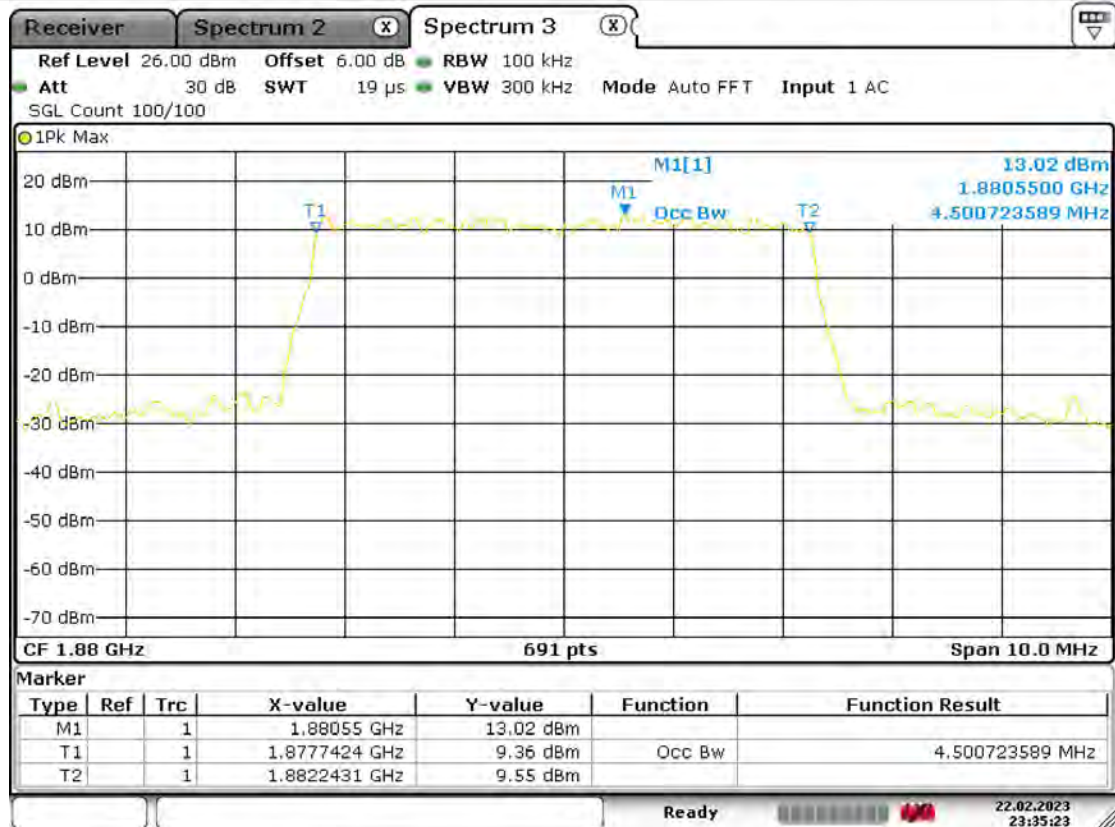


Date: 22.FEB.2023 23:35:23

Band2-5MHz-64QPSK-19175-6RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

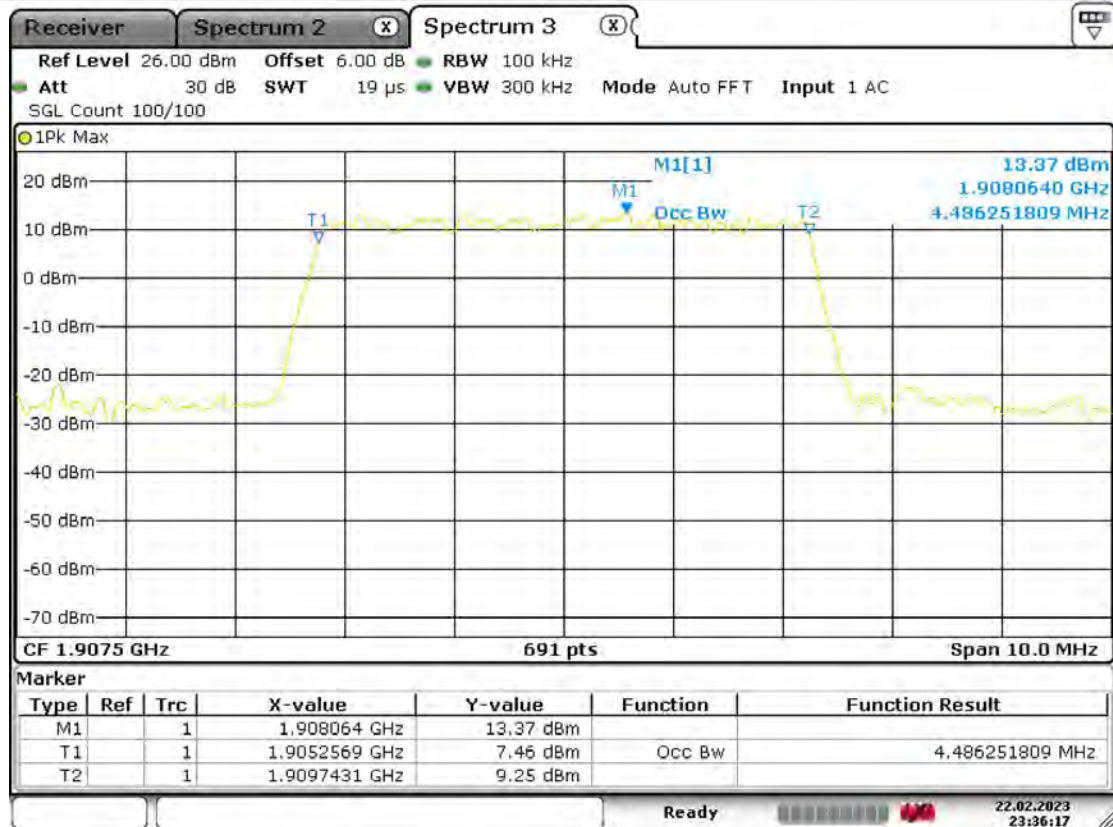


Date: 22.FEB.2023 23:36:17

Band2-10MHz-64QPSK-18650-6RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

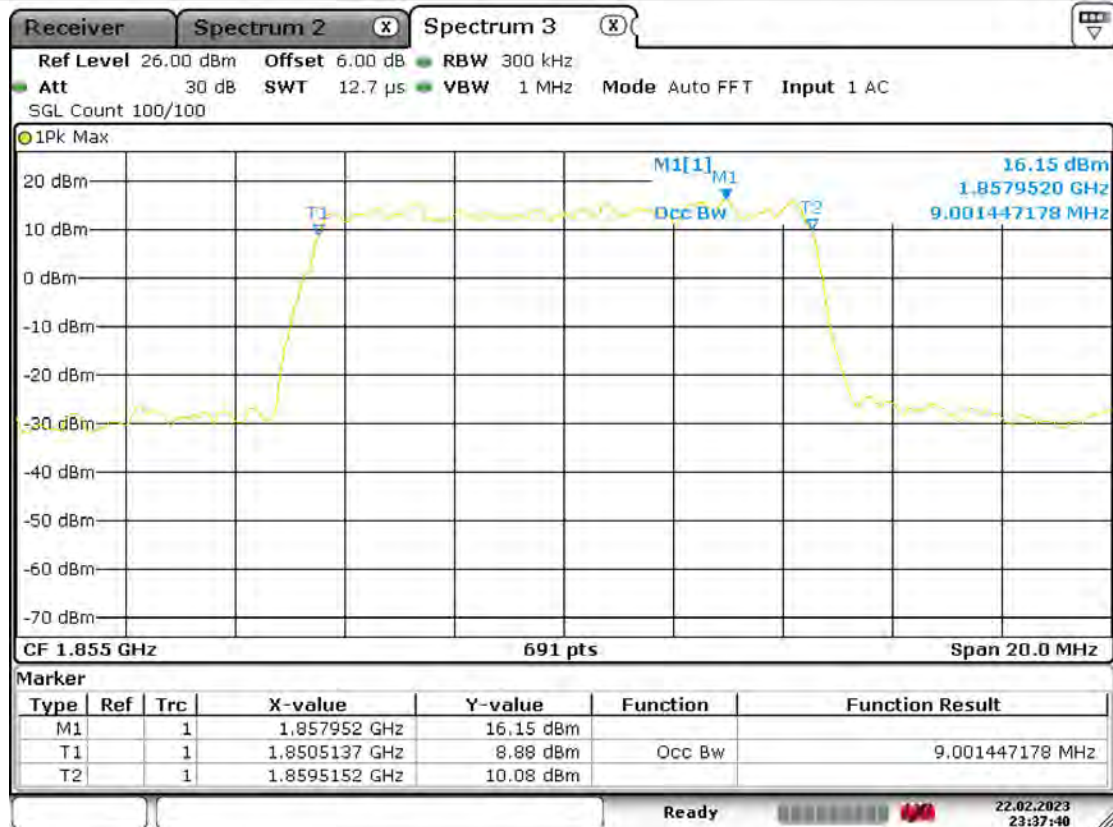


Date: 22.FEB.2023 23:37:40

Band2-10MHz-64QPSK-18900-6RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

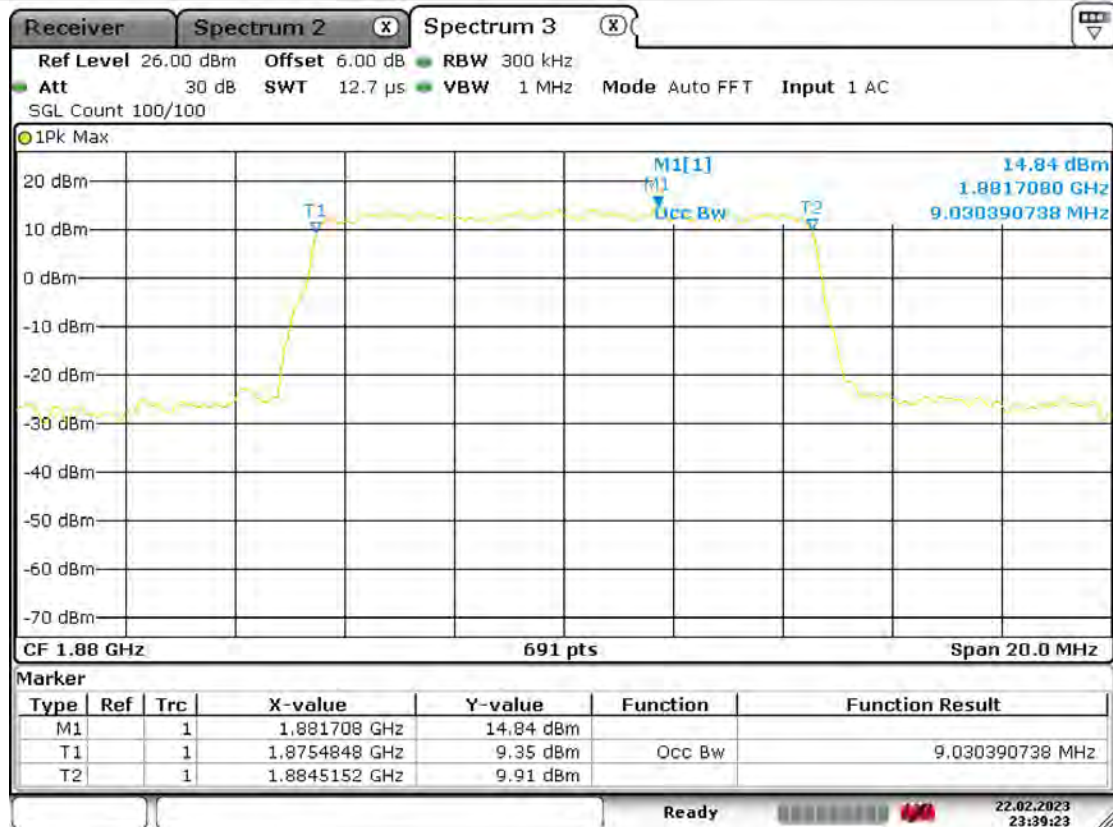


Date: 22.FEB.2023 23:39:23

Band2-10MHz-64QPSK-19150-6RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

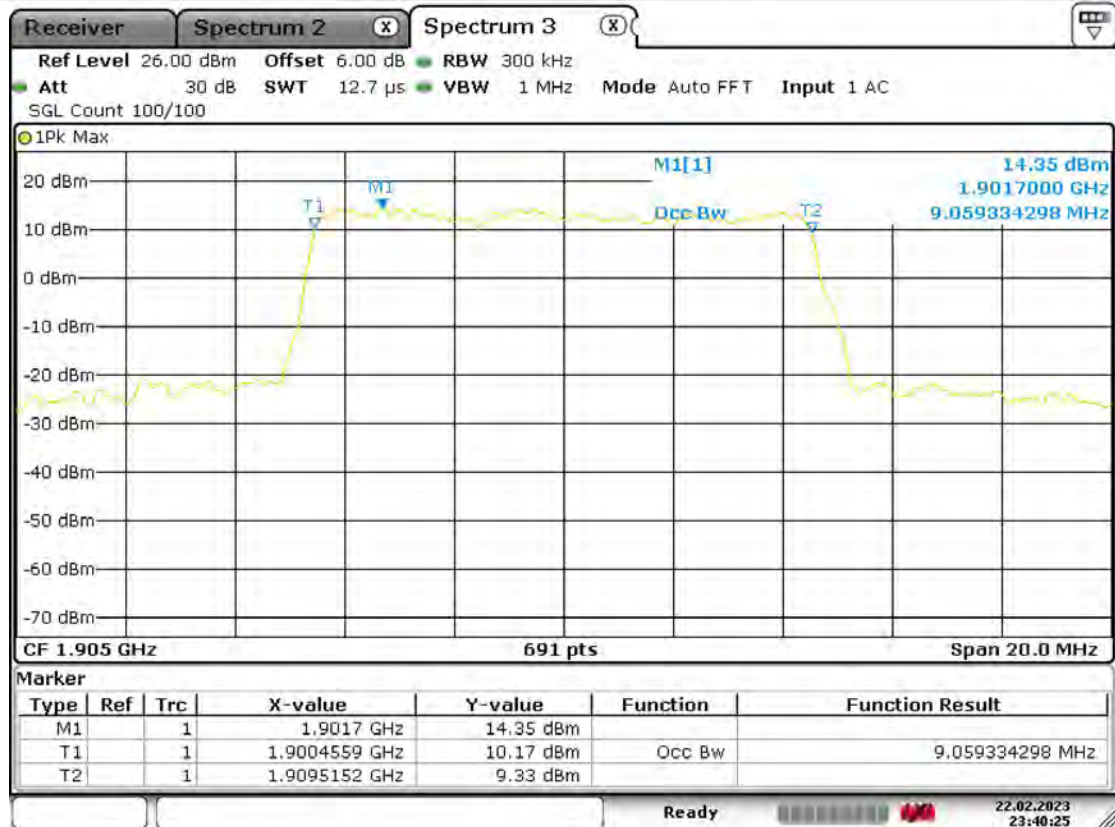


Date: 22.FEB.2023 23:40:25

Band2-15MHz-64QPSK-18675-6RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

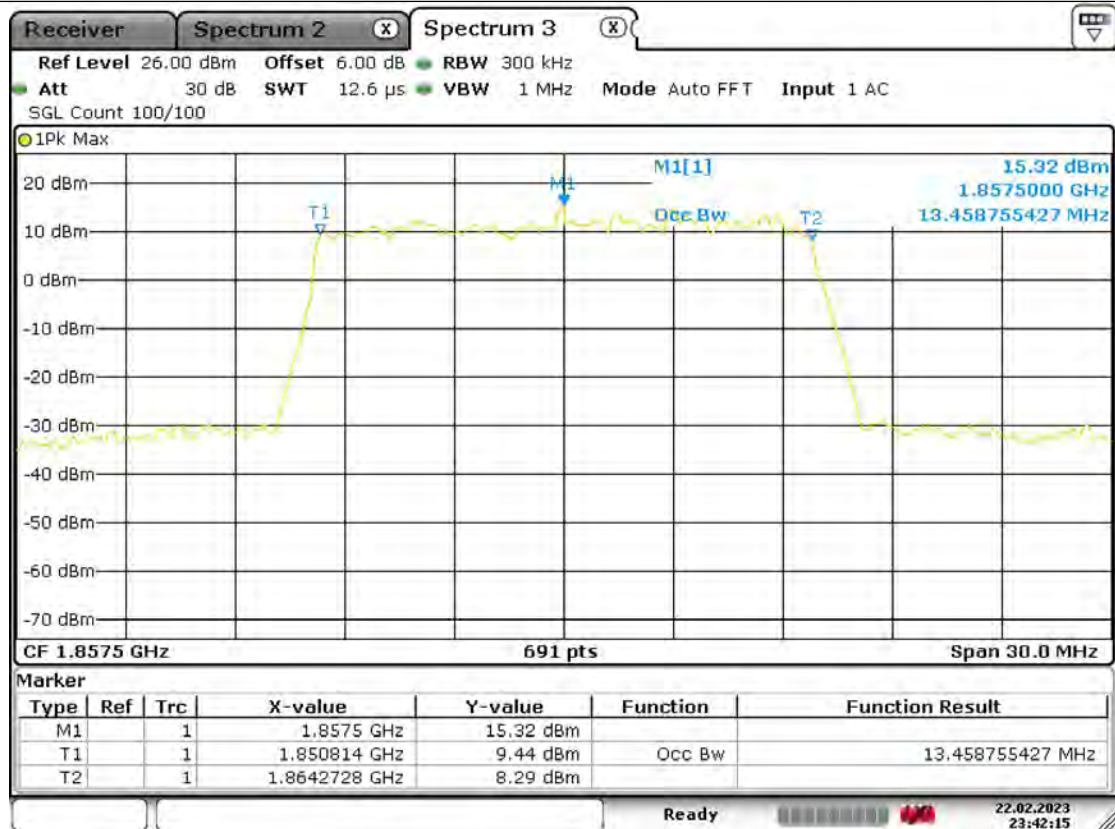


Date: 22.FEB.2023 23:42:15

Band2-15MHz-64QPSK-18900-6RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

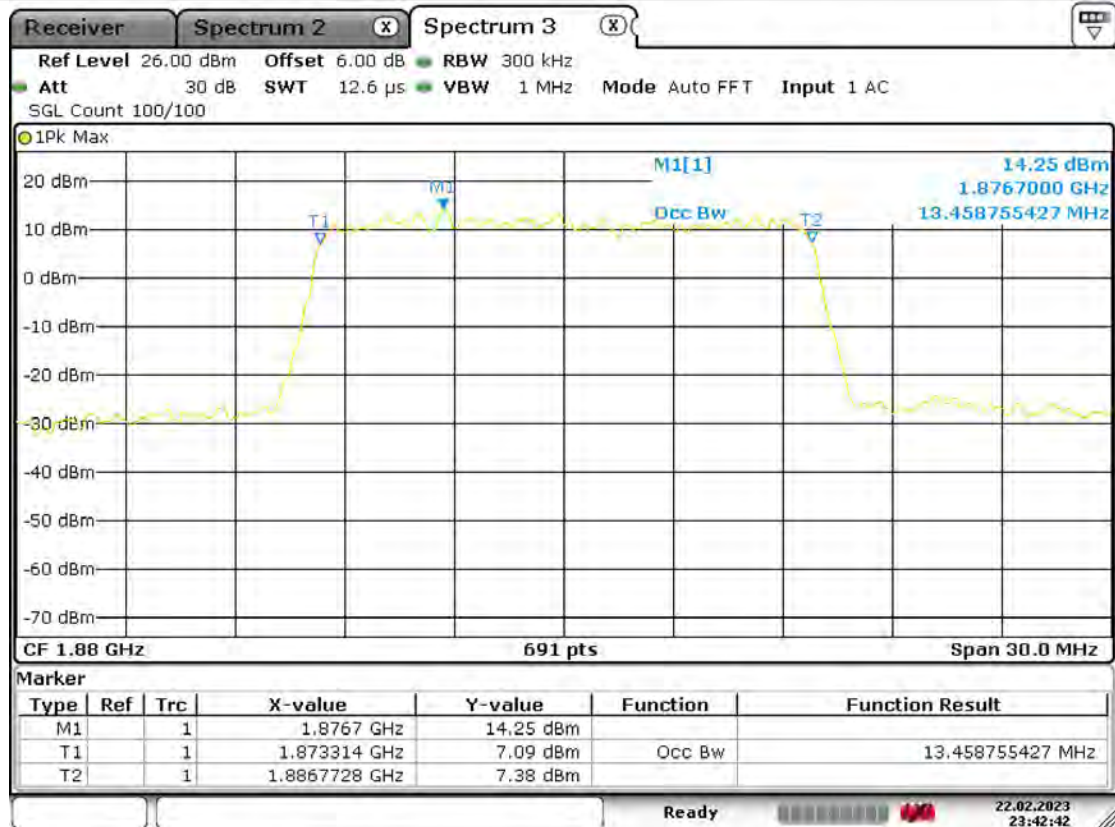


Date: 22.FEB.2023 23:42:42

Band2-15MHz-64QPSK-19125-6RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

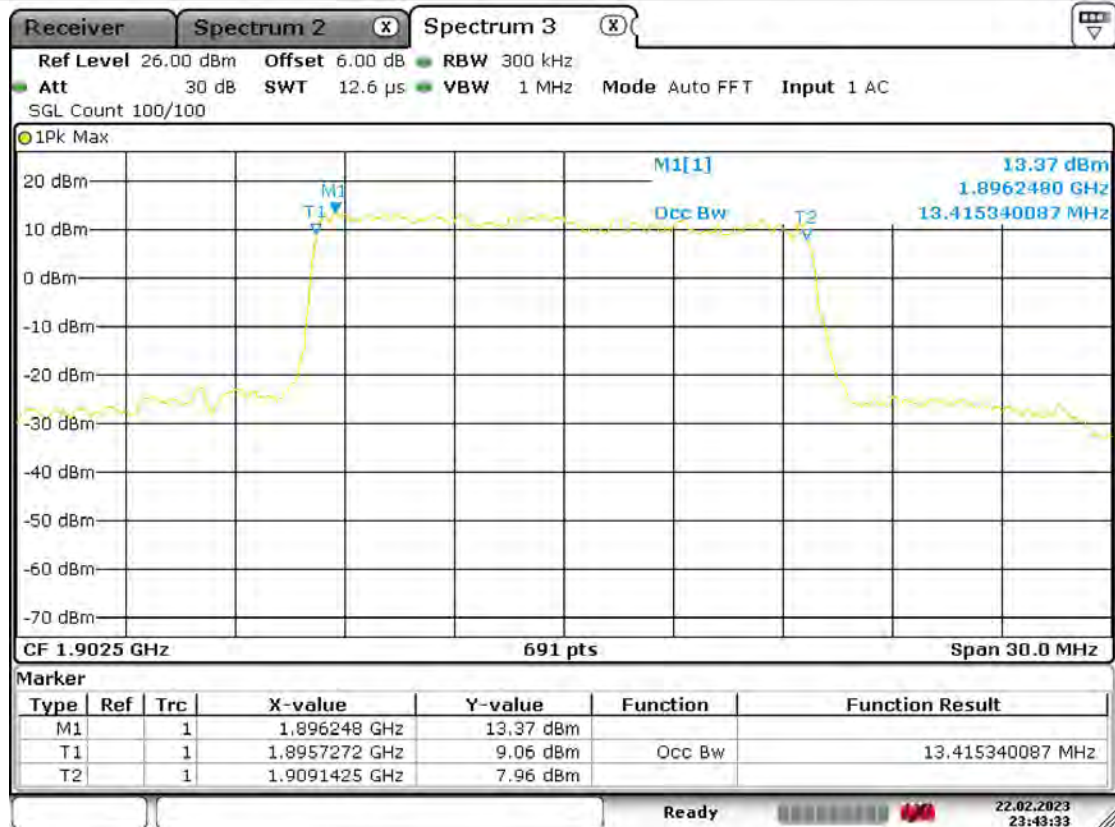


Date: 22.FEB.2023 23:43:33

Band2-20MHz-64QPSK-18700-6RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

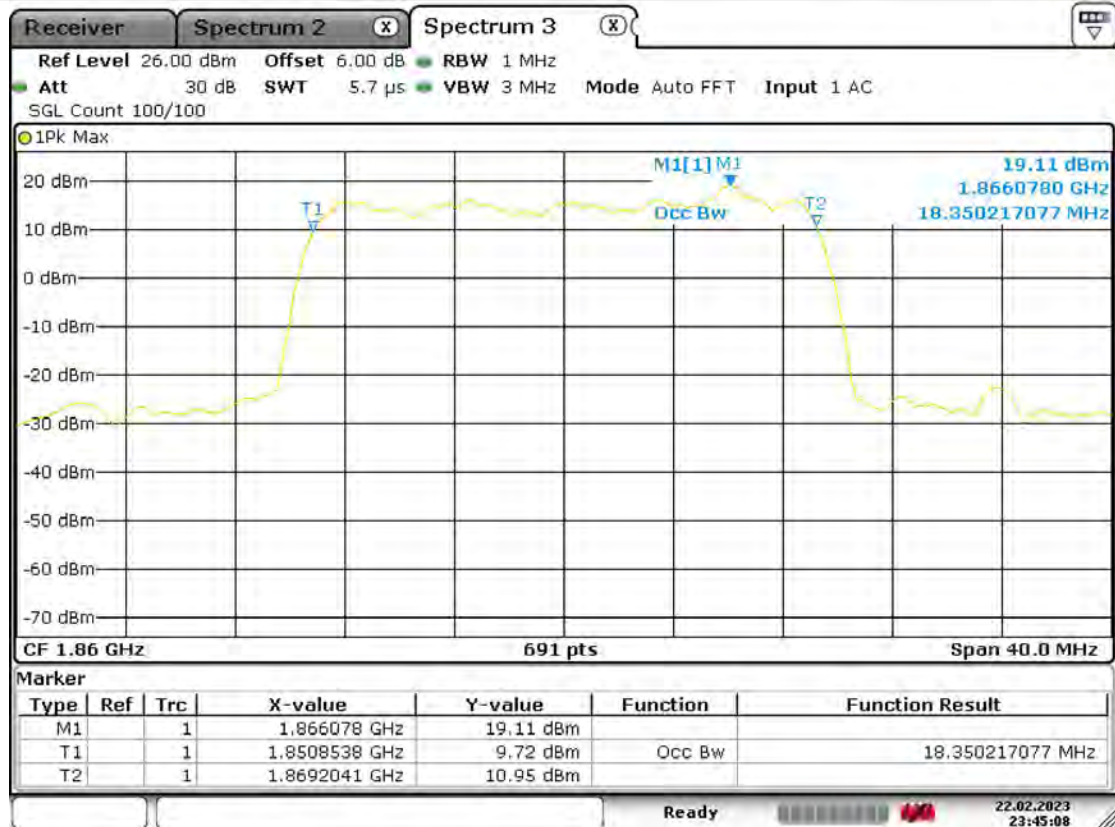


Date: 22.FEB.2023 23:45:08

Band2-20MHz-64QPSK-18900-6RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

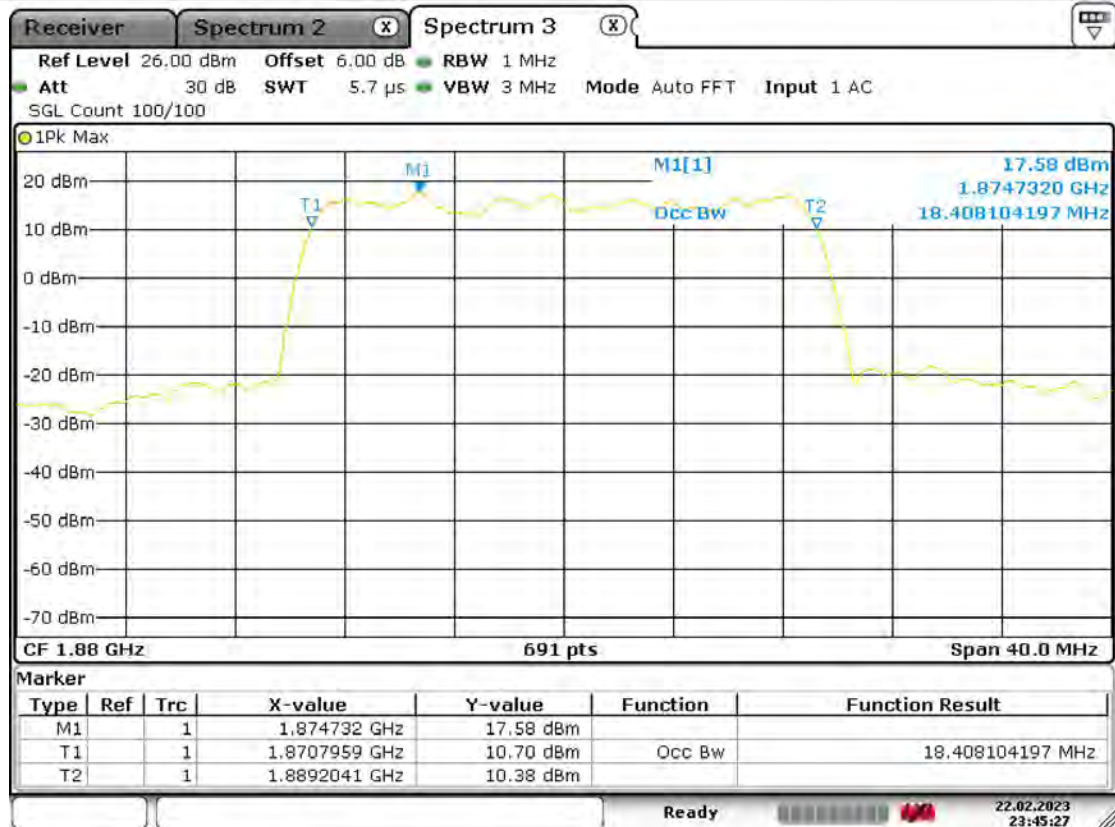


Date: 22.FEB.2023 23:45:27

Band2-20MHz-64QPSK-19100-6RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

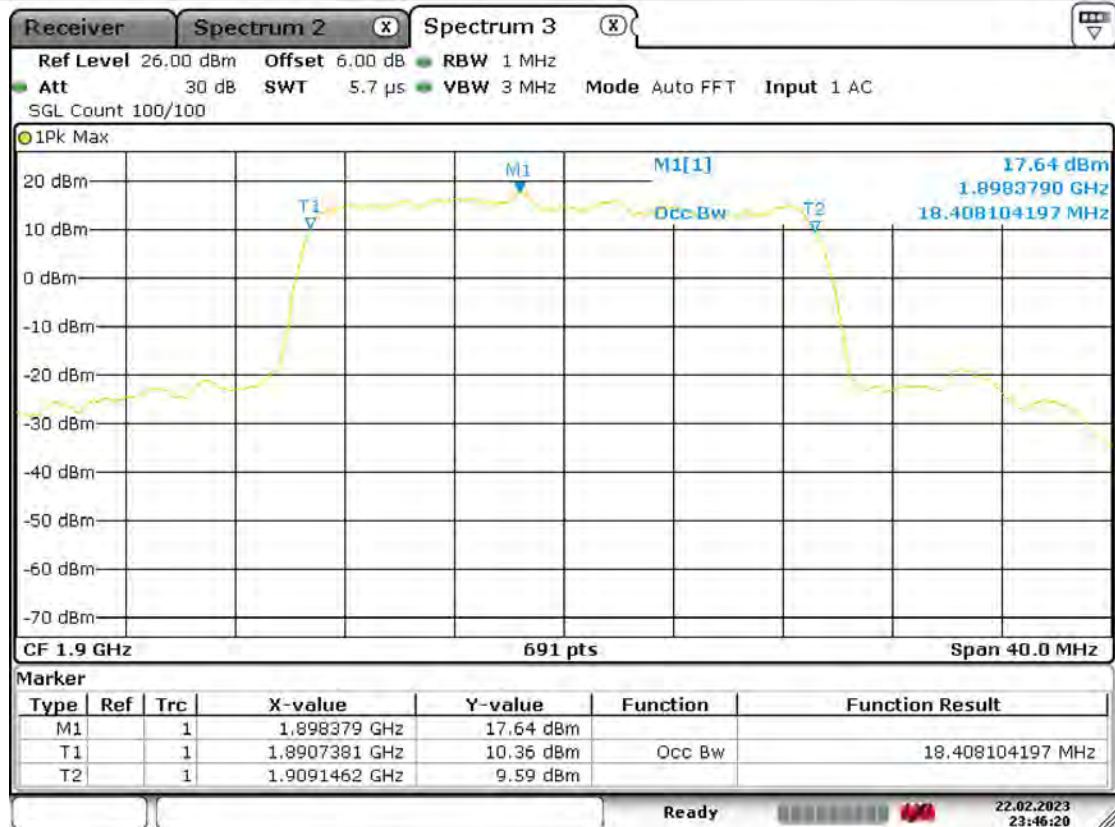

Date: 22.FEB.2023 23:46:20

26dB Bandwidth

Band2-1.4MHz-QPSK-18607-6RB#0

Huarui 7layers High Technology (Suzhou)
Co., Ltd.


Tower N, Innovation Center, 88 Zhuyi Road, High-tech
District, Suzhou City, Anhui Province

Tel: +86 (0557) 368 1008



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

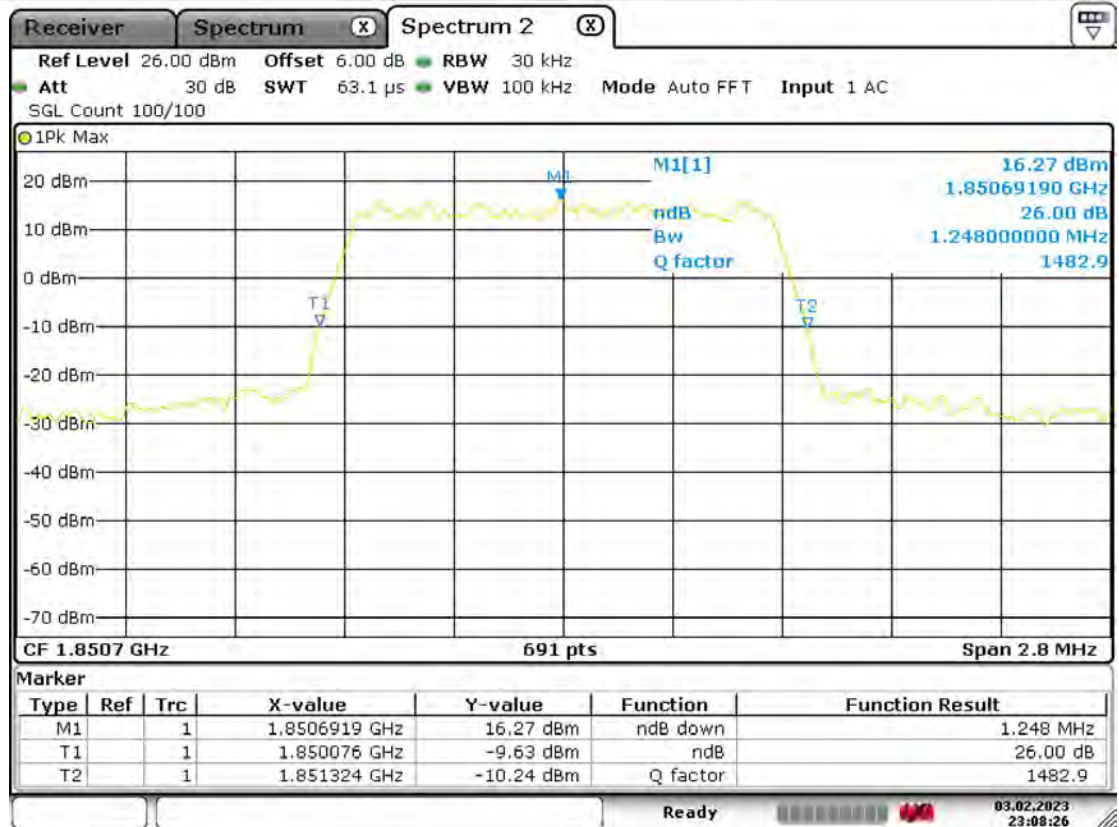


Date: 3.FEB.2023 23:08:26

Band2-1.4MHz-QPSK-18900-6RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

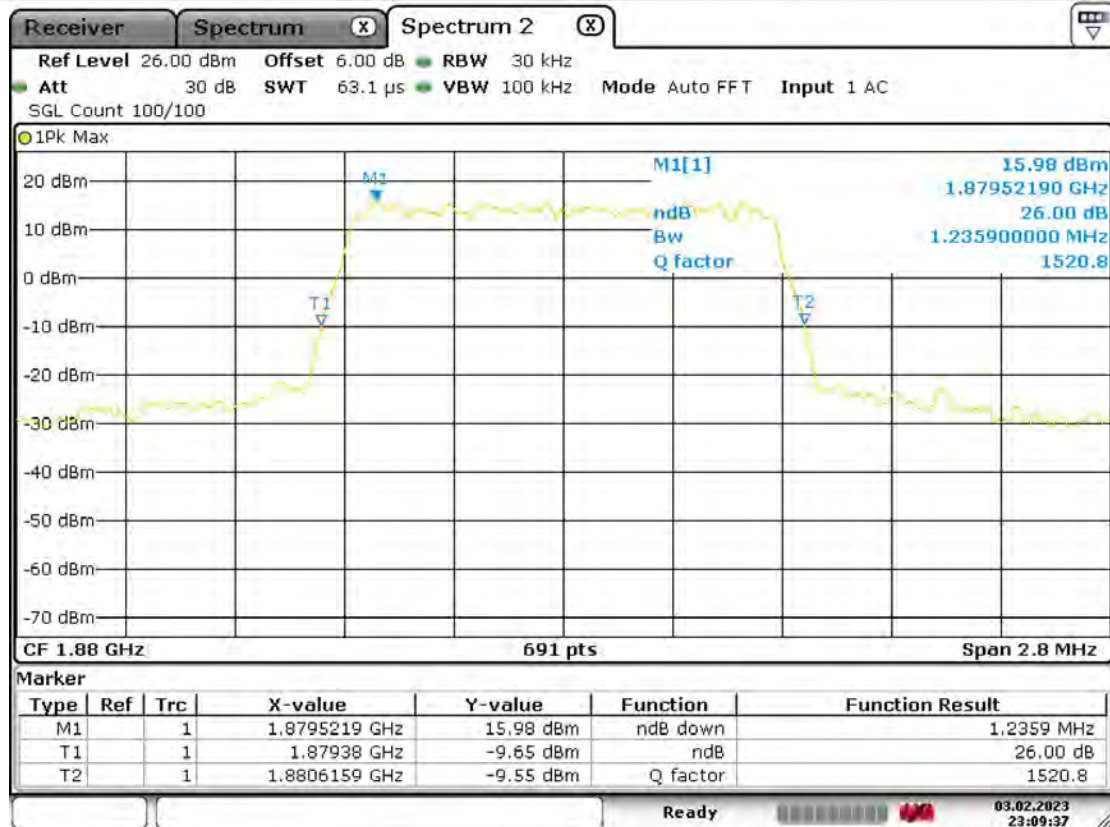


Date: 3.FEB.2023 23:09:37

Band2-1.4MHz-QPSK-19193-6RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

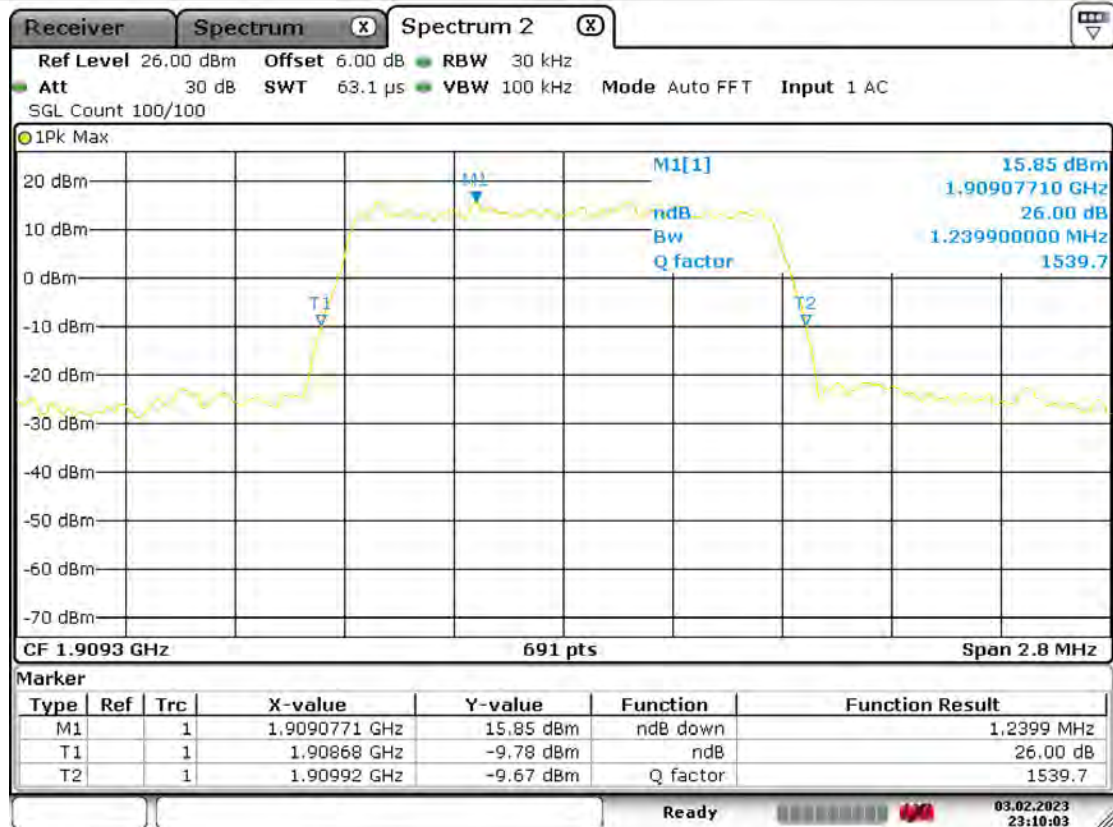


Date: 3.FEB.2023 23:10:03

Band2-1.4MHz-16QAM-18607-6RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

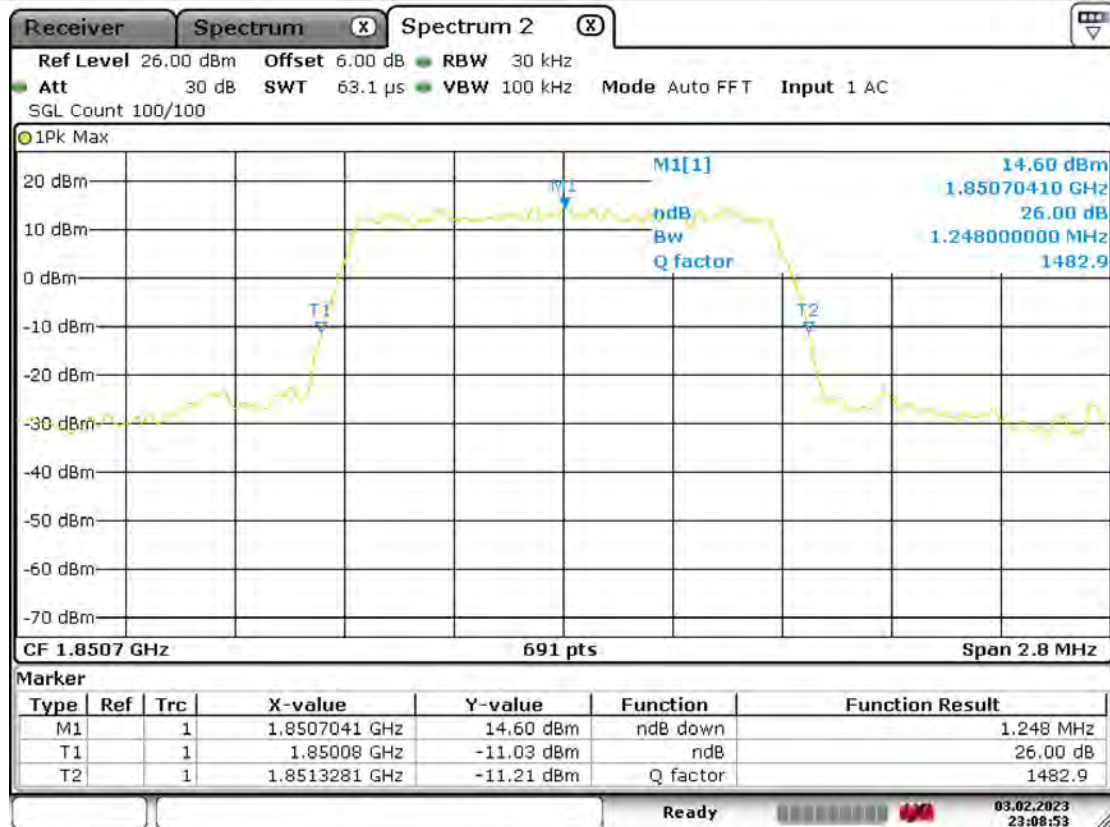


Date: 3.FEB.2023 23:08:53

Band2-1.4MHz-16QAM-18900-6RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

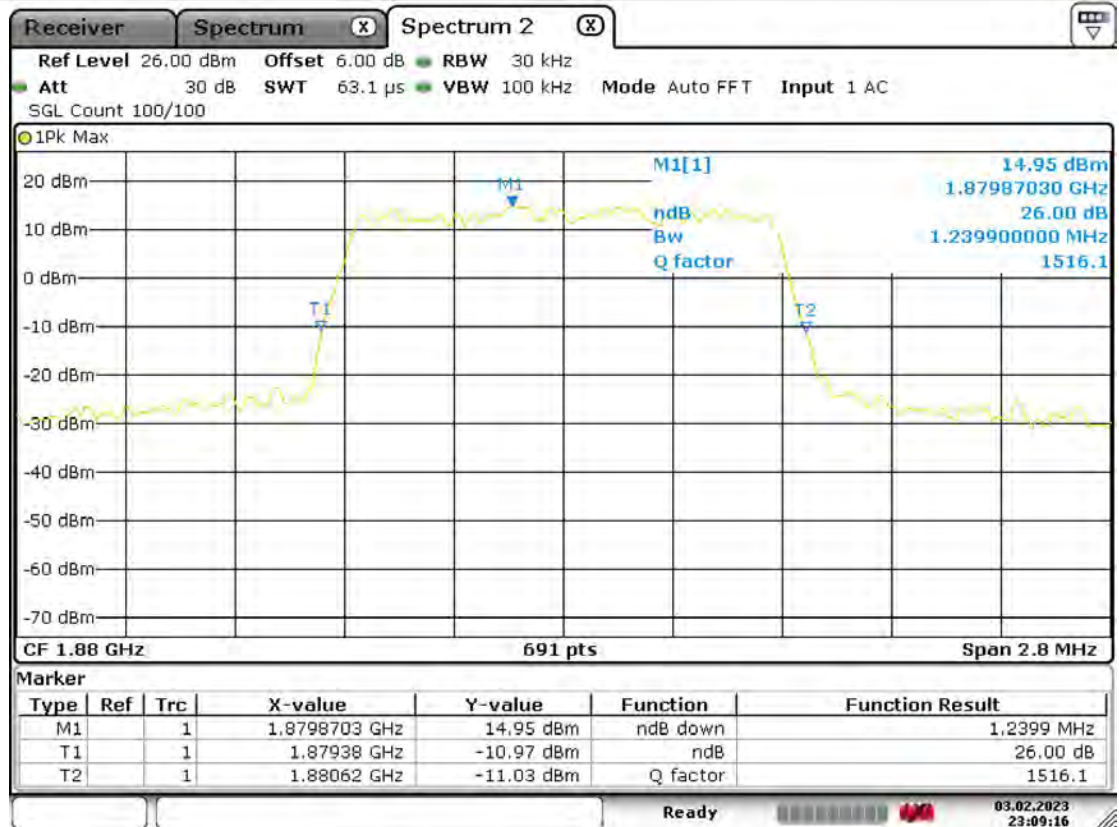


Date: 3.FEB.2023 23:09:15

Band2-1.4MHz-16QAM-19193-6RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

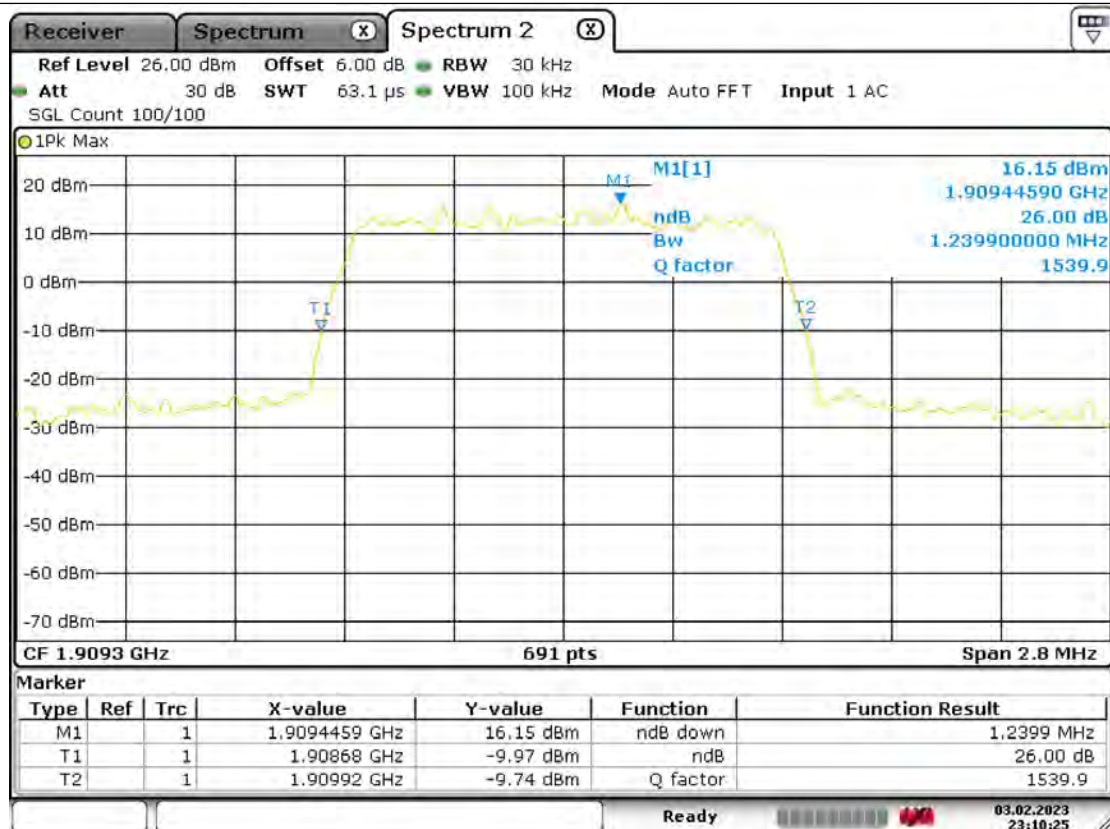


Date: 3.FEB.2023 23:10:25

Band2-3MHz-QPSK-18615-15RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

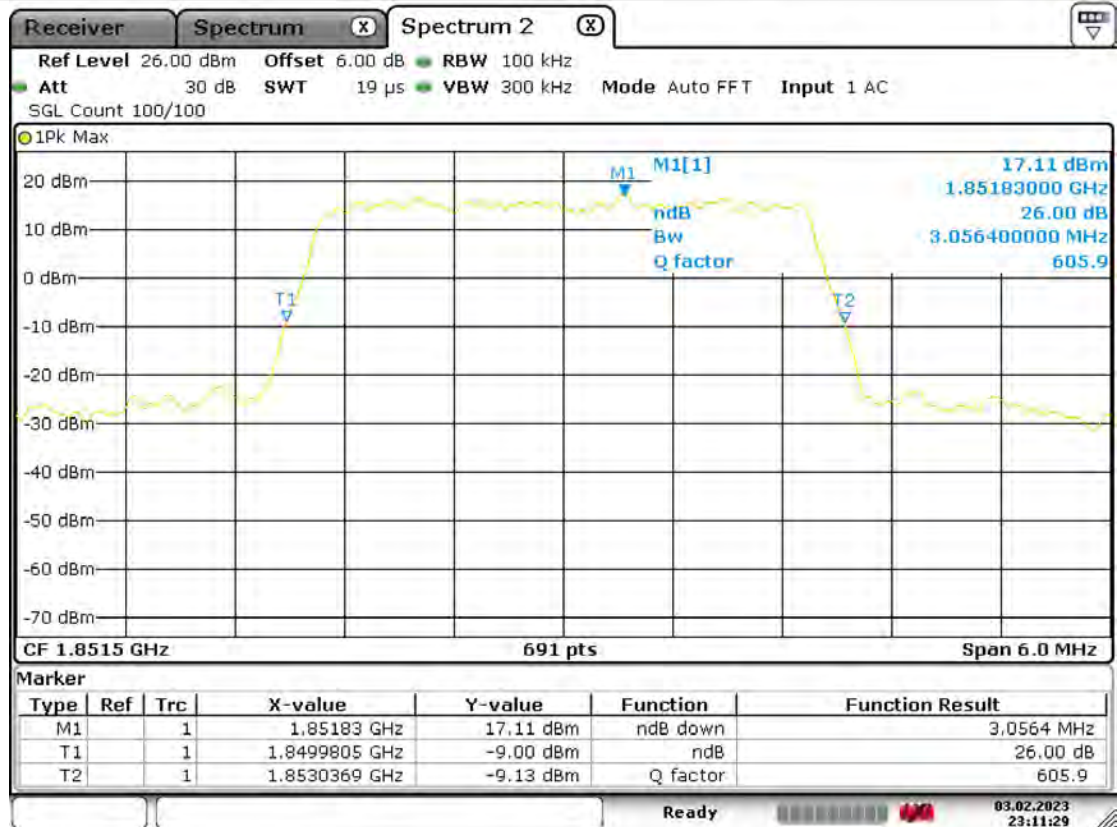


Date: 3.FEB.2023 23:11:28

Band2-3MHz-QPSK-18900-15RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

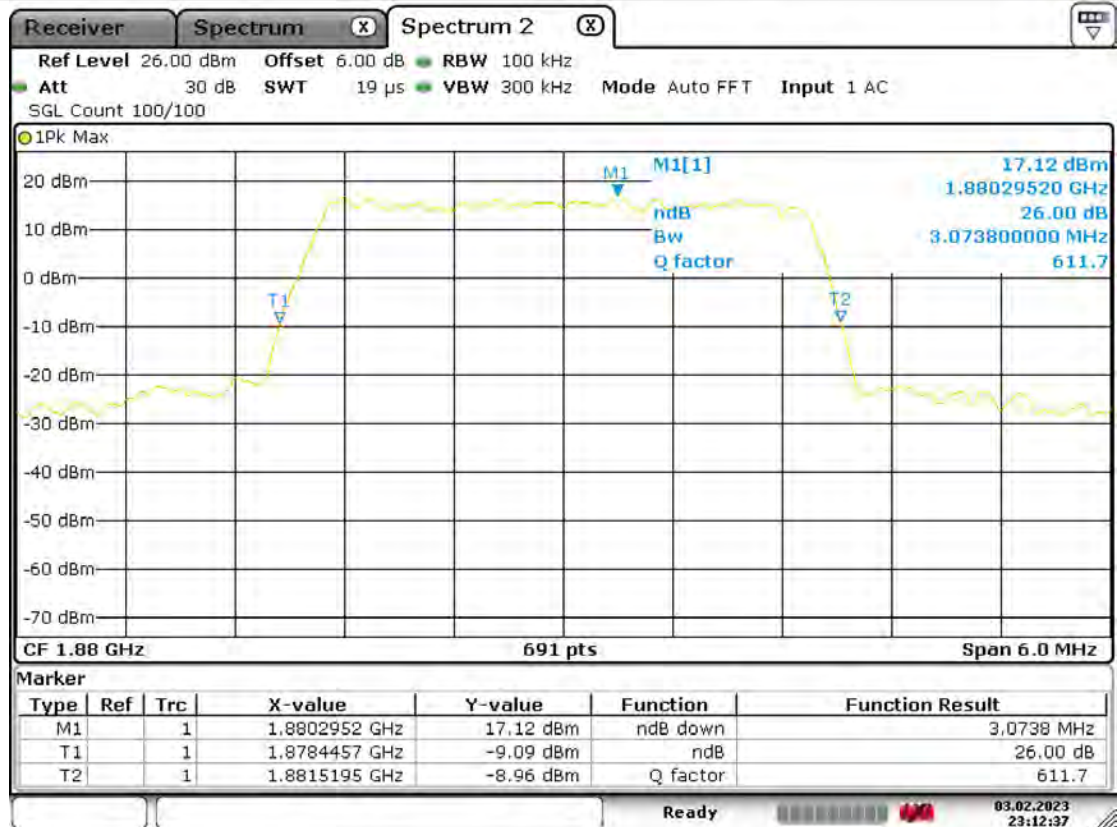


Date: 3.FEB.2023 23:12:36

Band2-3MHz-QPSK-19185-15RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

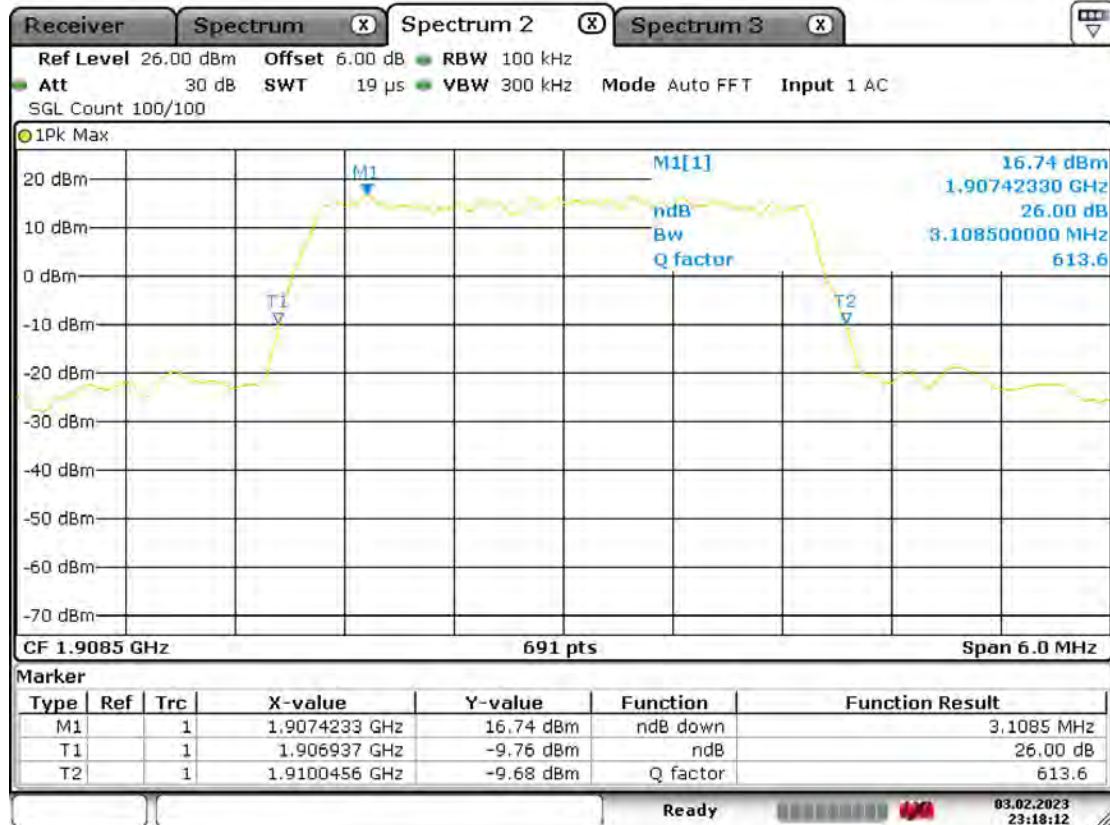


Date: 3.FEB.2023 23:18:11

Band2-3MHz-16QAM-18615-15RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

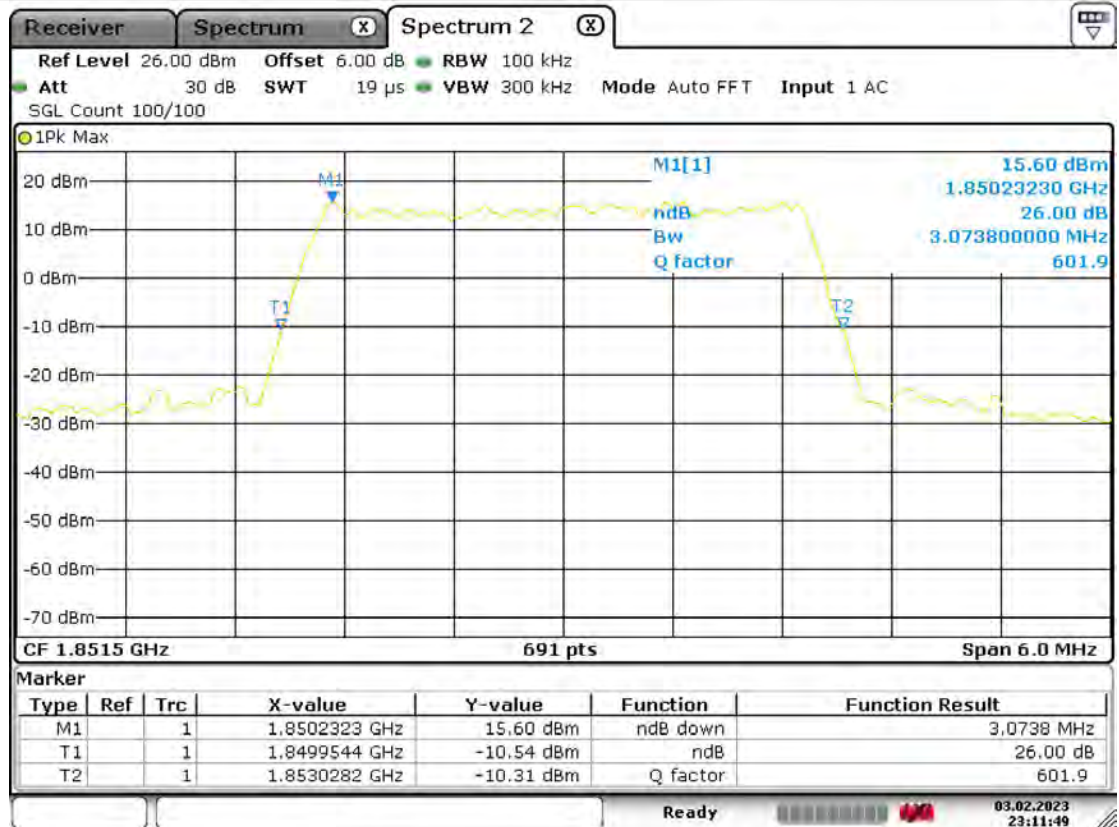


Date: 3.FEB.2023 23:11:49

Band2-3MHz-16QAM-18900-15RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

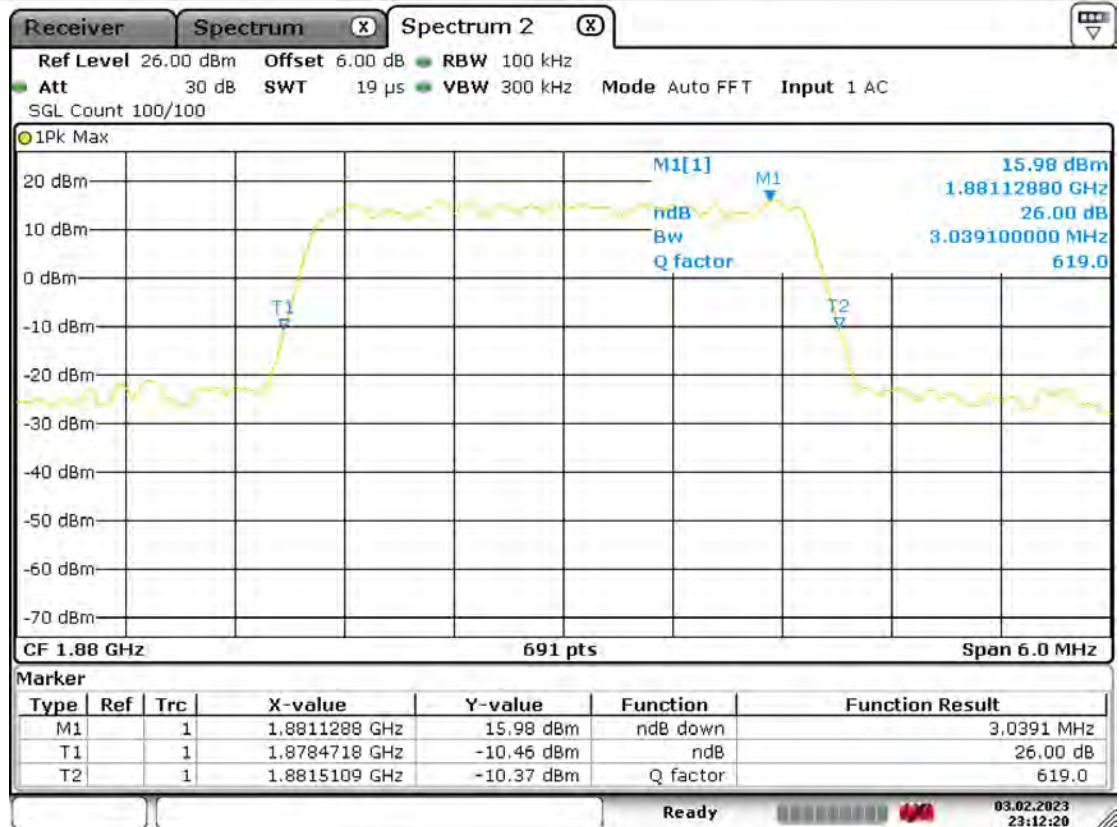


Date: 3.FEB.2023 23:12:19

Band2-3MHz-16QAM-19185-15RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

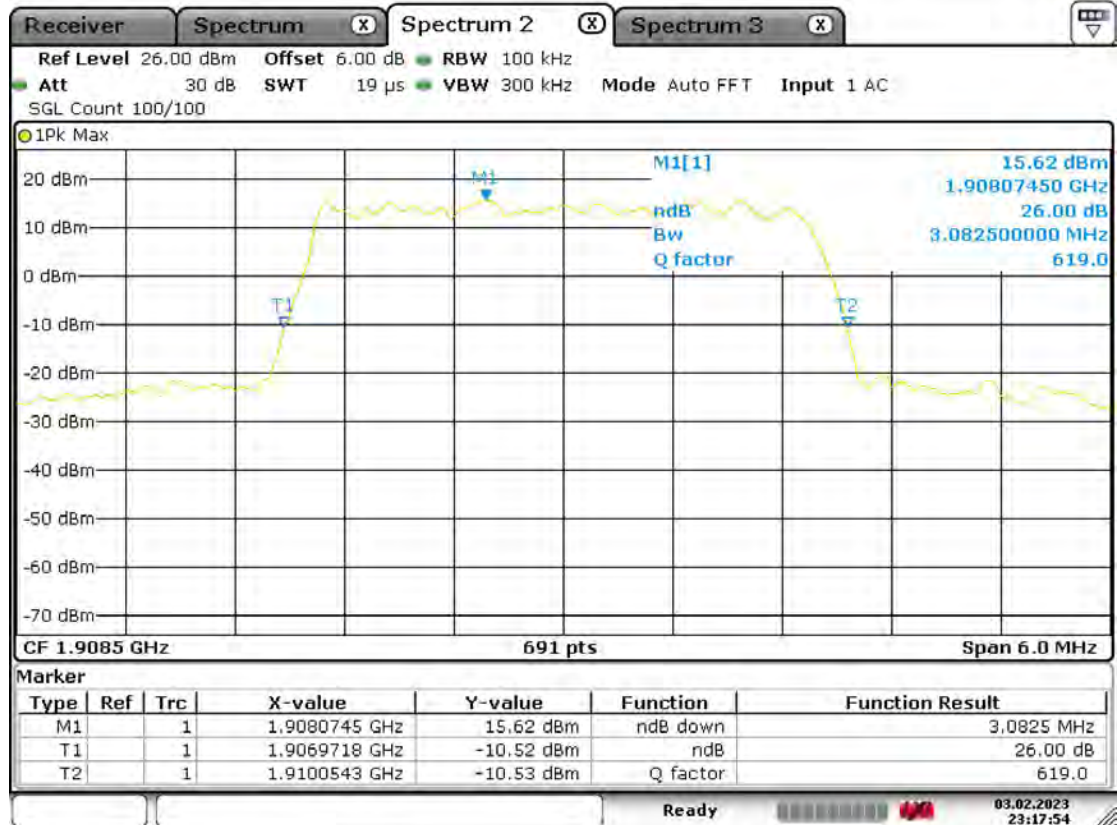


Date: 3.FEB.2023 23:17:54

Band2-5MHz-QPSK-18625-25RB#0



BUREAU
VERITAS


Test Report No.: PSU-QSU2308280314RF02

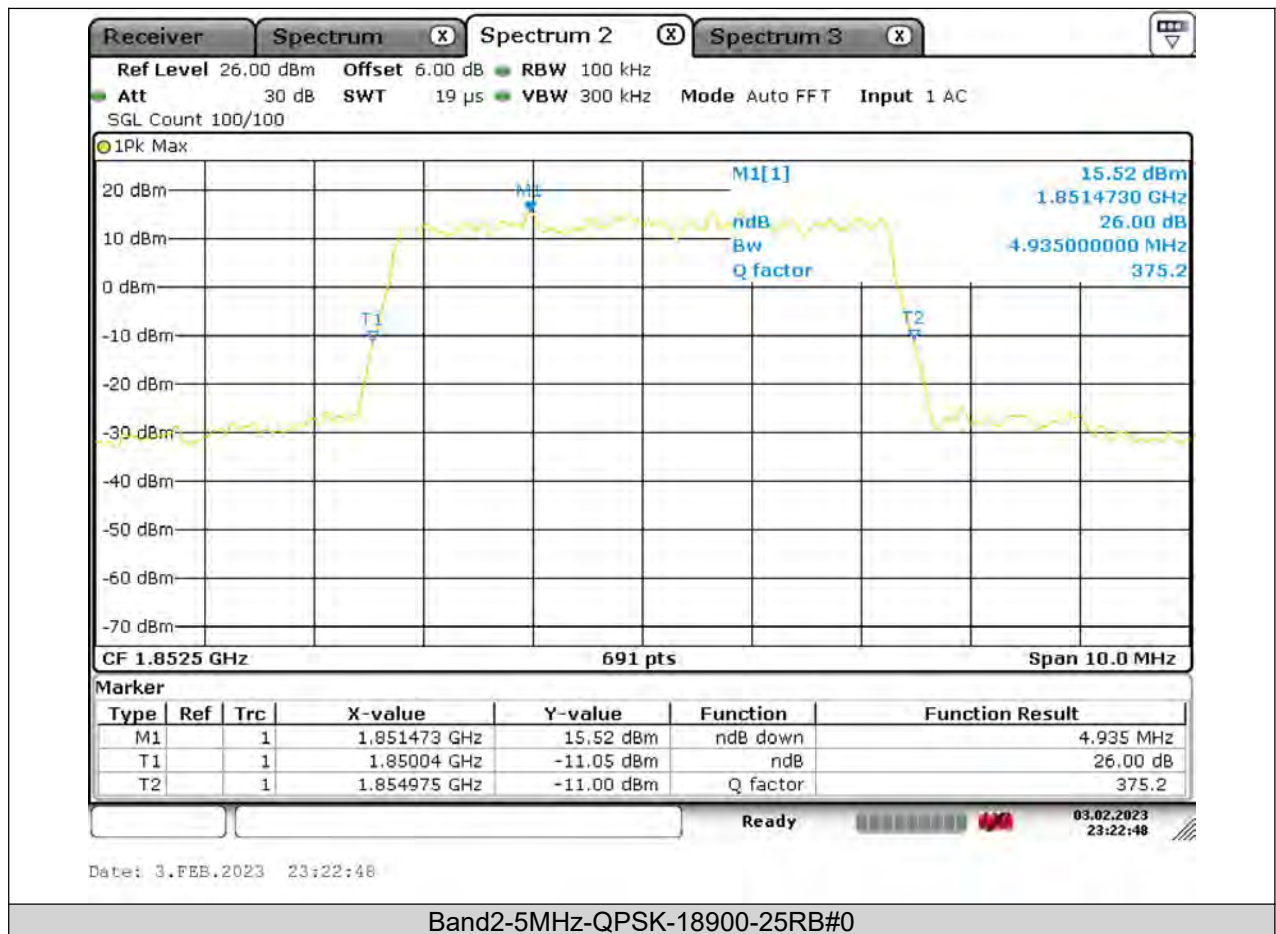



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

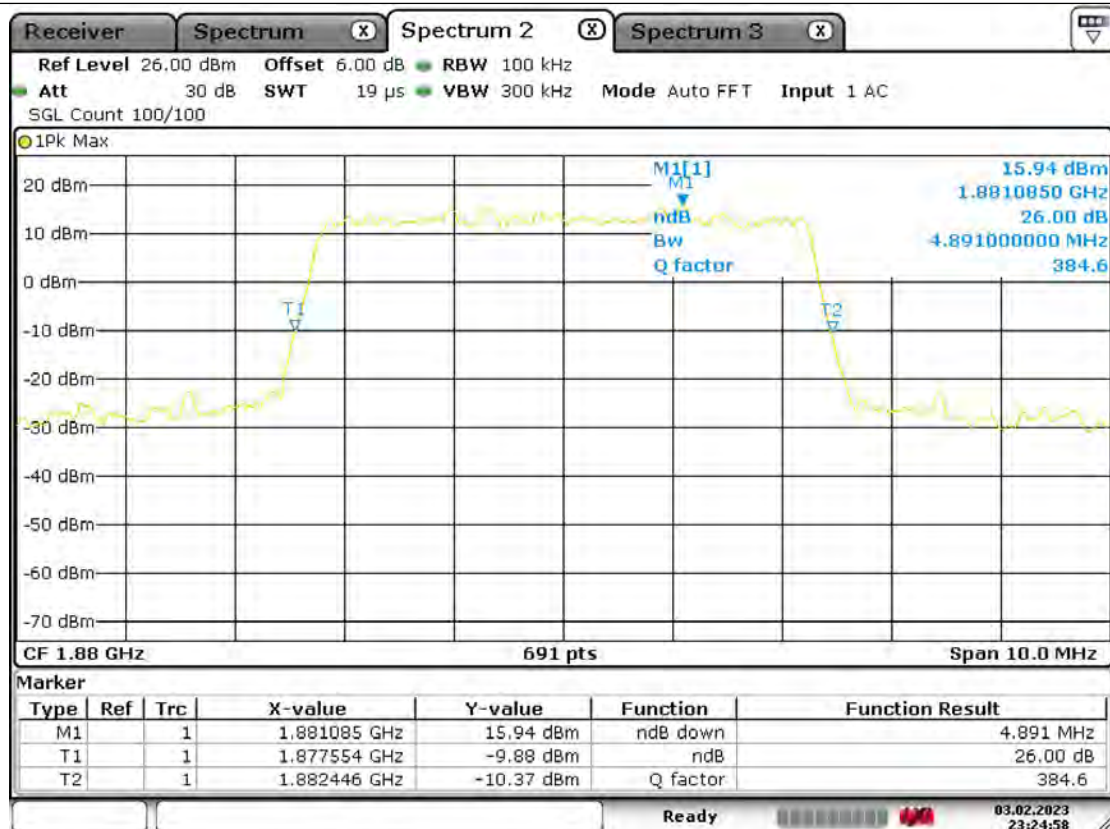


Date: 3.FEB.2023 23:24:57

Band2-5MHz-QPSK-19175-25RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

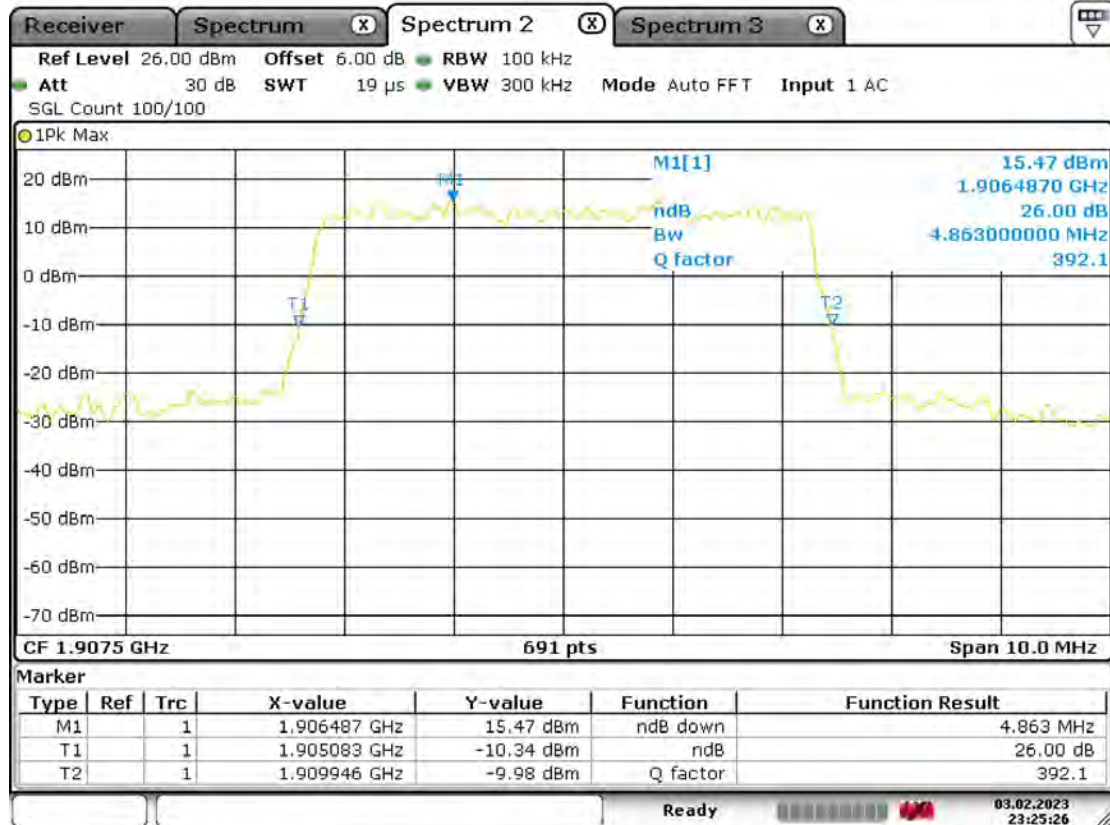


Date: 3.FEB.2023 23:25:26

Band2-5MHz-16QAM-18625-25RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

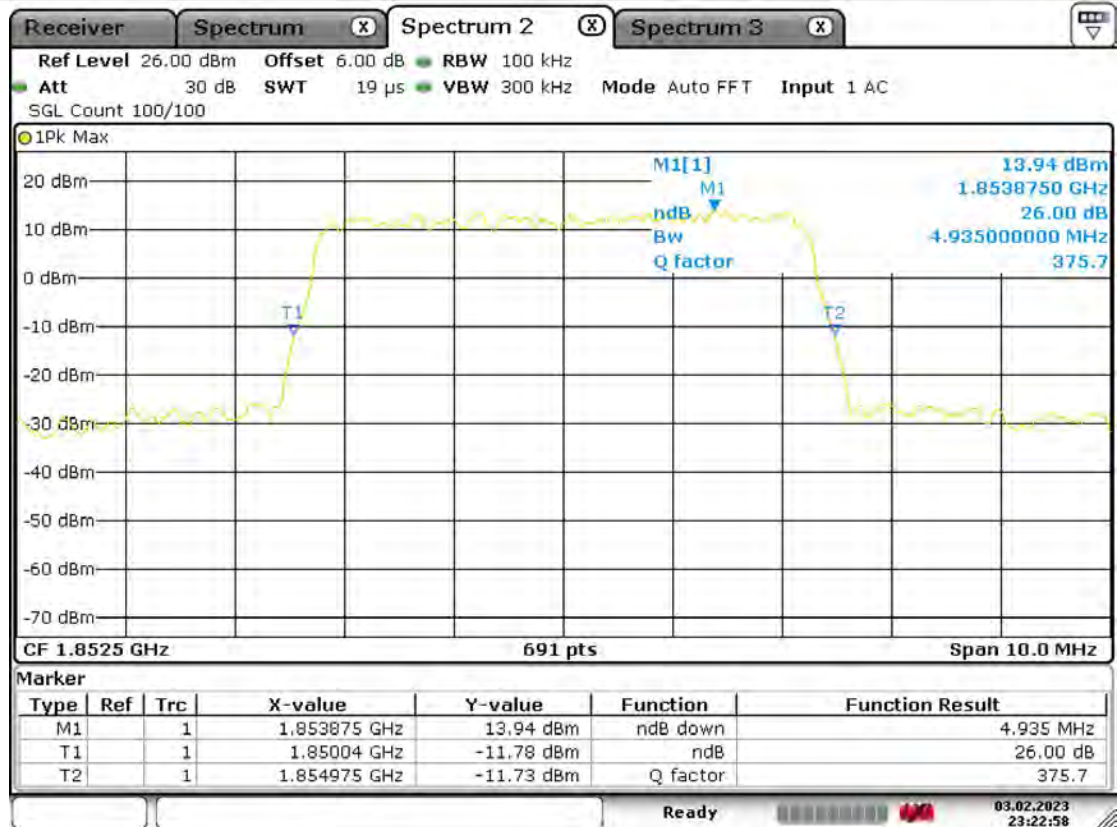


Date: 3.FEB.2023 23:22:58

Band2-5MHz-16QAM-18900-25RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

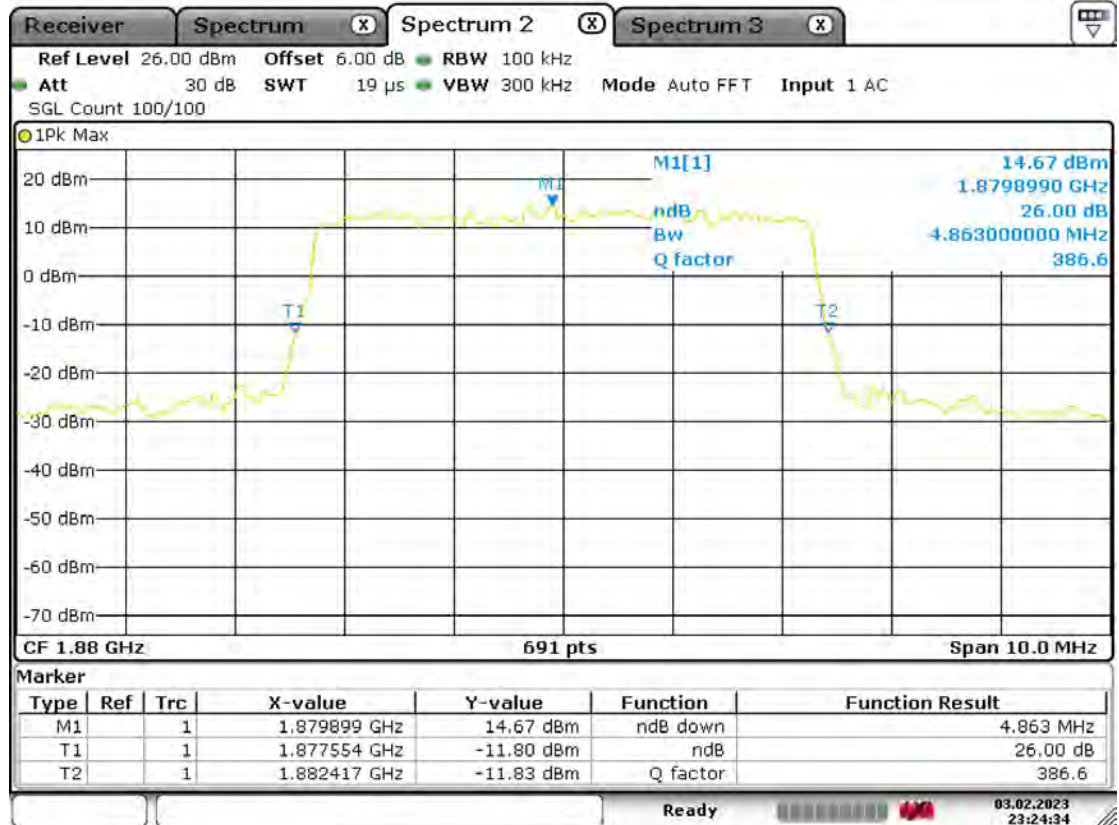


Date: 3.FEB.2023 23:24:34

Band2-5MHz-16QAM-19175-25RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

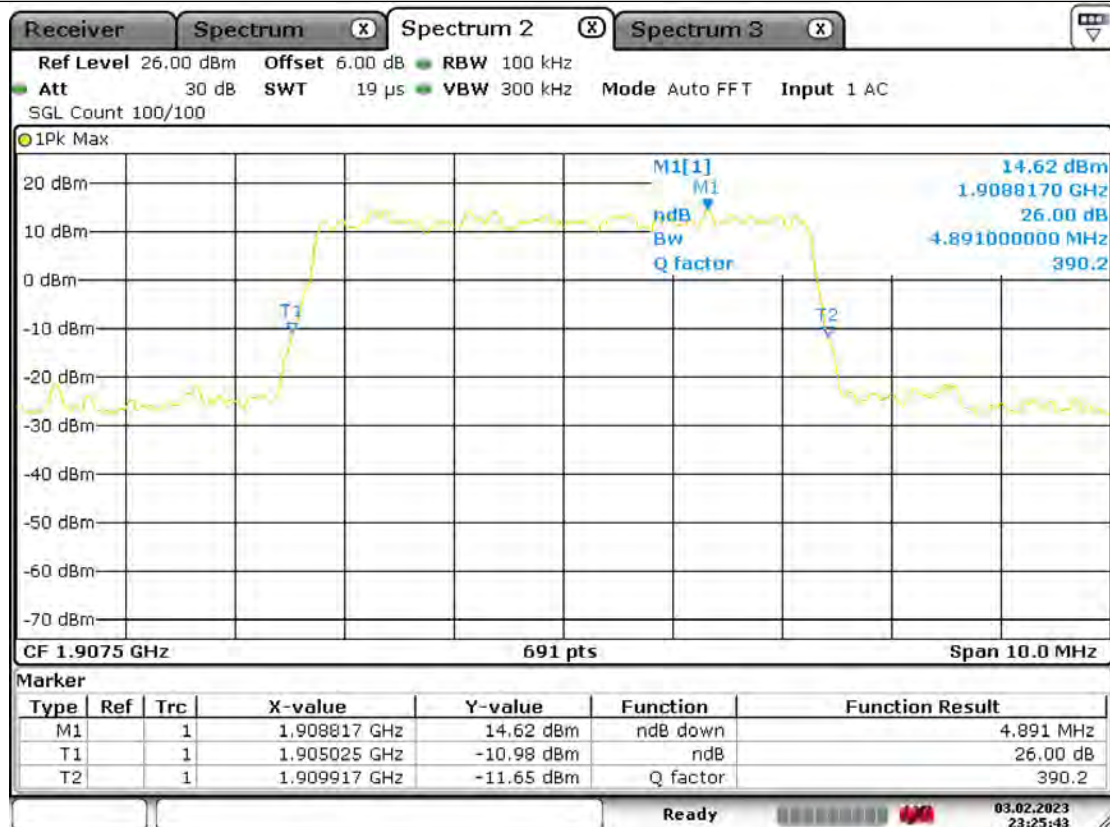


Date: 3.FEB.2023 23:25:43

Band2-10MHz-QPSK-18650-50RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

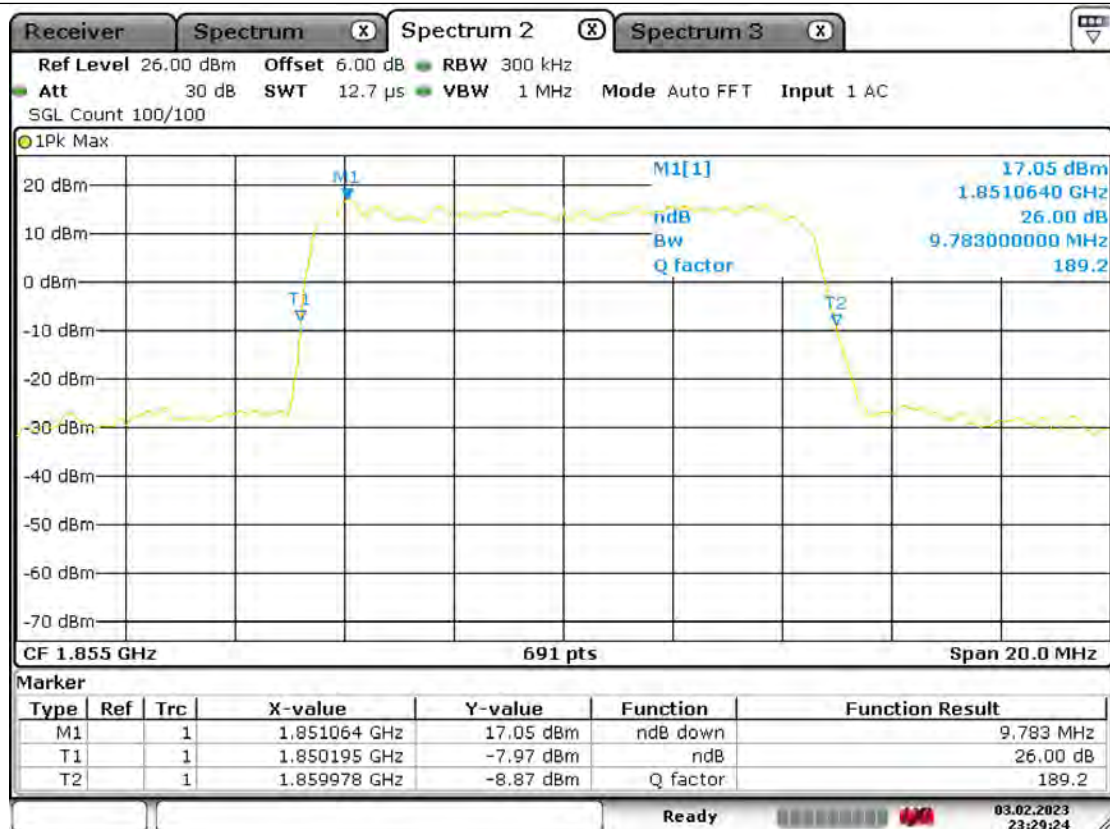


Date: 3.FEB.2023 23:29:24

Band2-10MHz-QPSK-18900-50RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

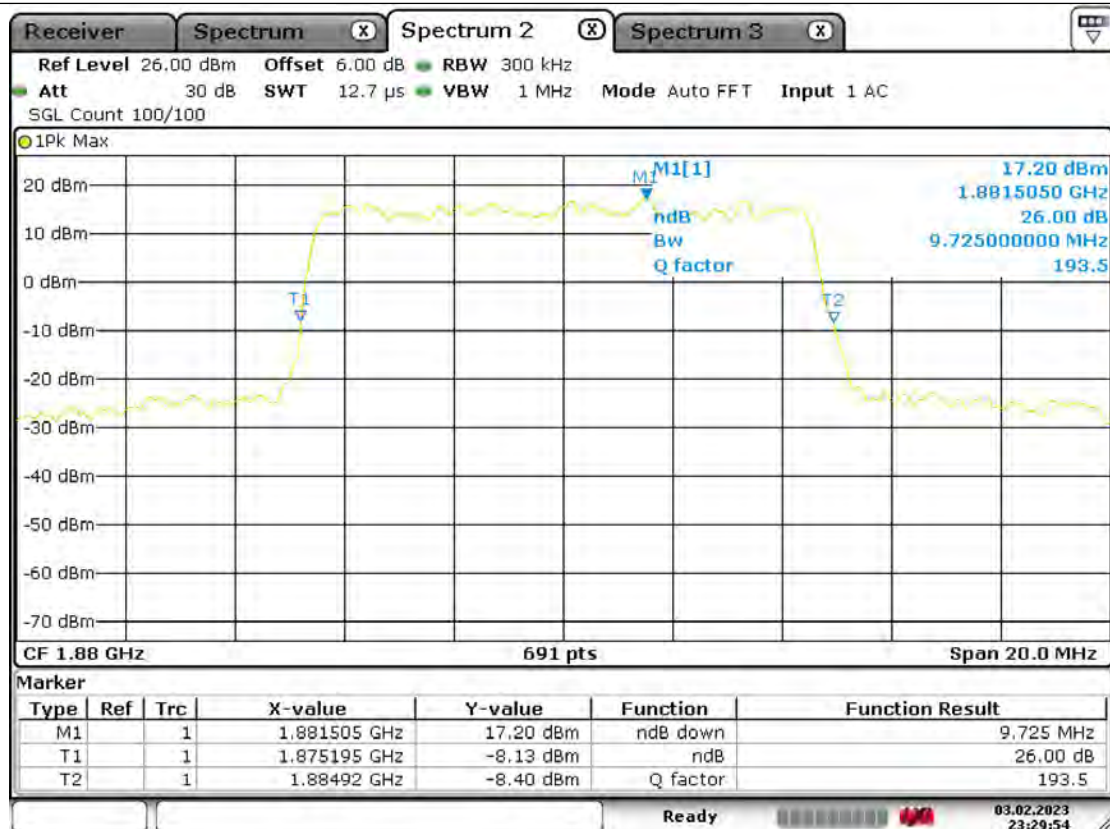


Date: 3.FEB.2023 23:29:54

Band2-10MHz-QPSK-19150-50RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

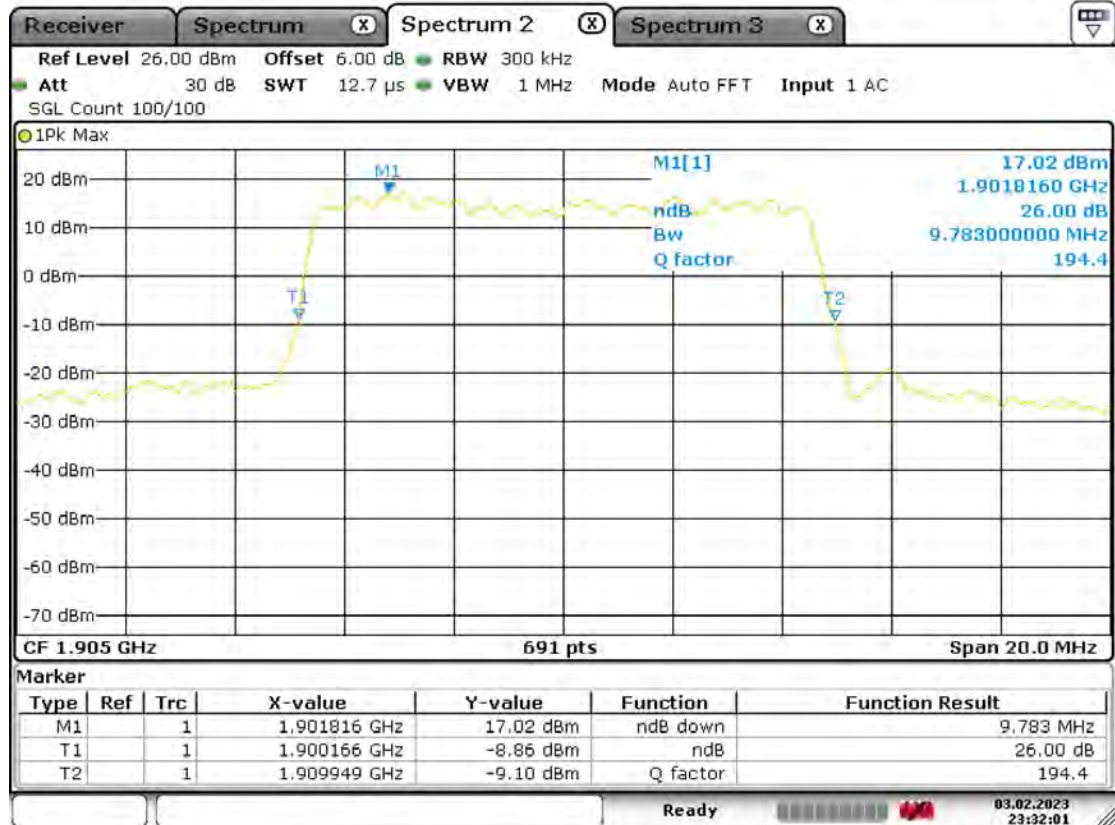


Date: 3.FEB.2023 23:32:01

Band2-10MHz-16QAM-18650-50RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

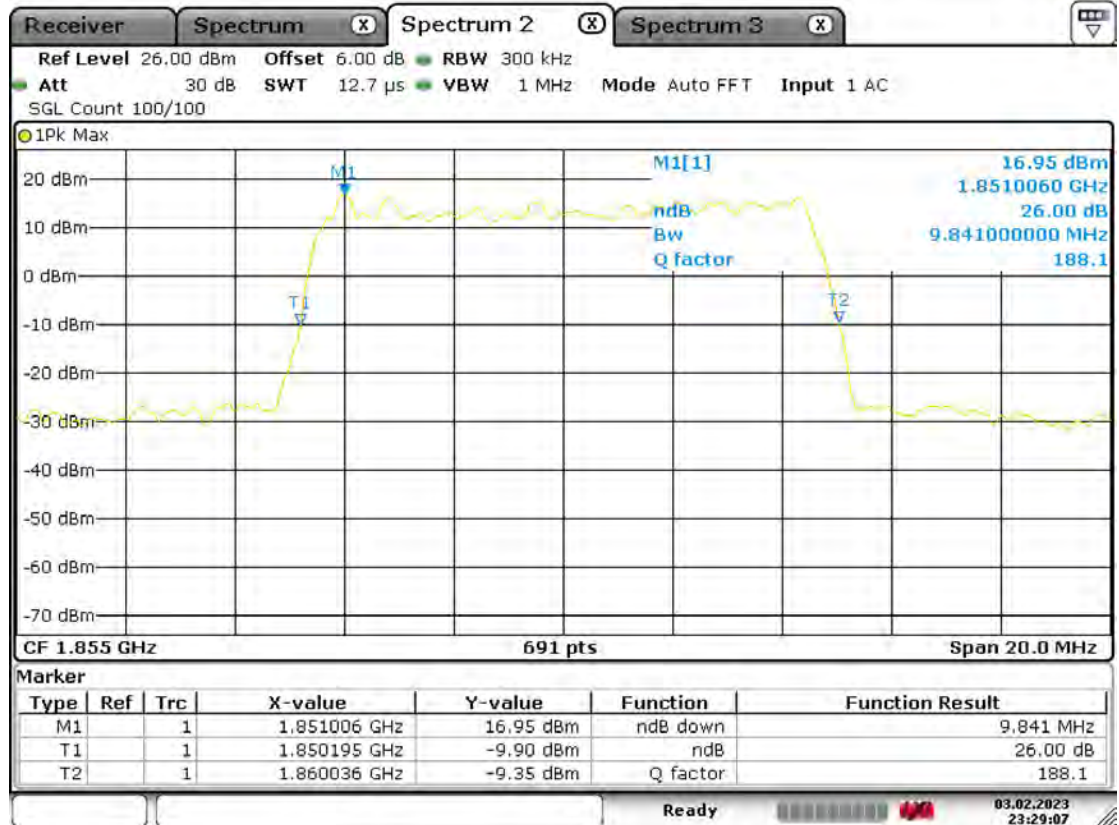


Date: 3.FEB.2023 23:29:07

Band2-10MHz-16QAM-18900-50RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

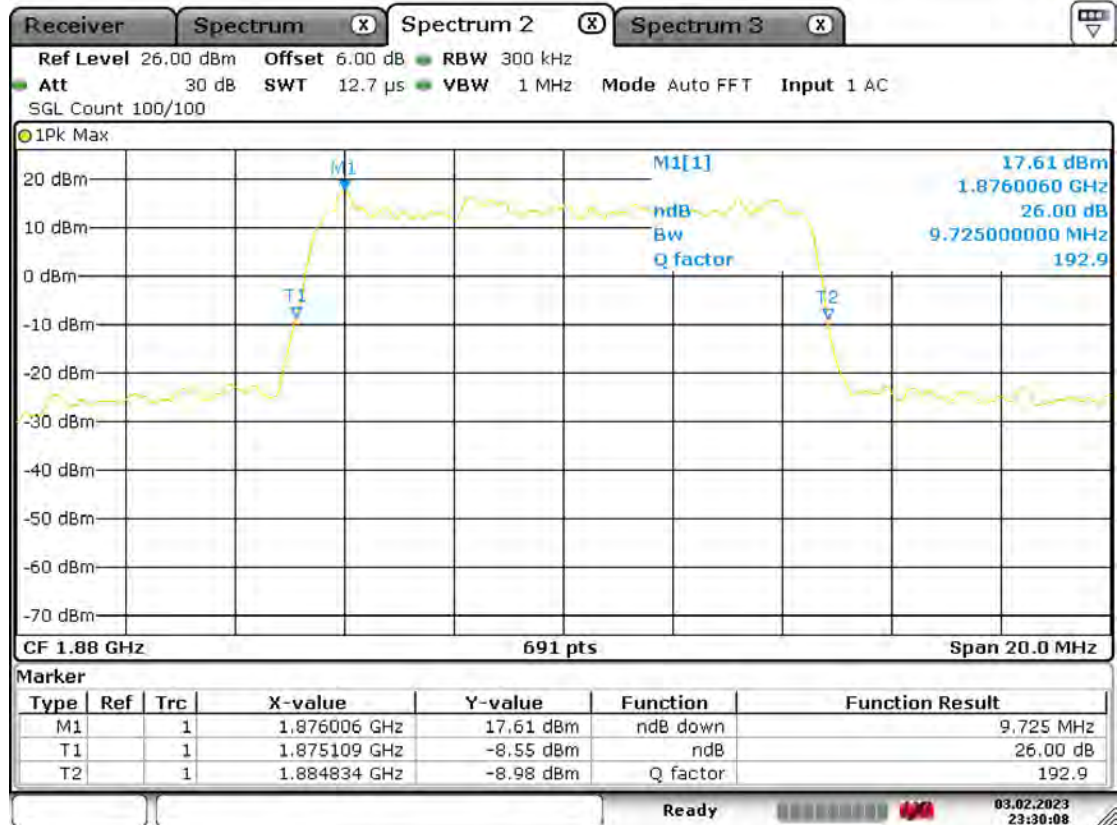


Date: 3.FEB.2023 23:30:08

Band2-10MHz-16QAM-19150-50RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

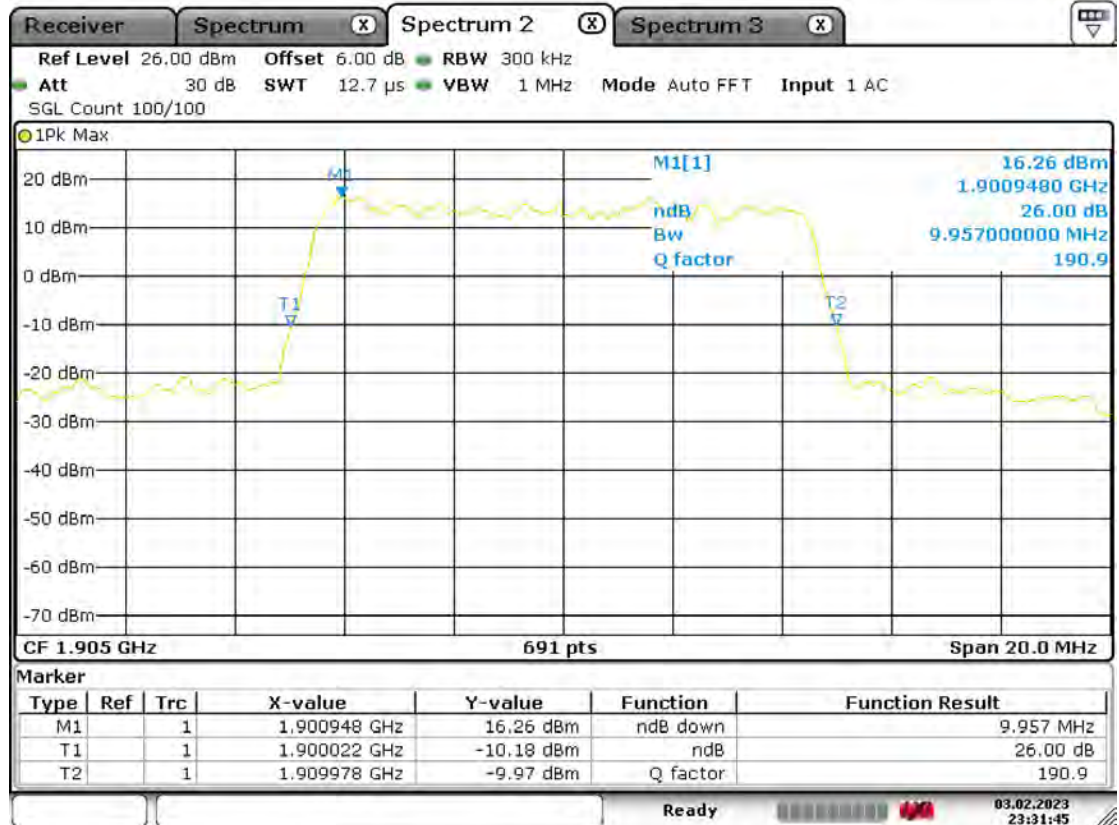


Date: 3.FEB.2023 23:31:45

Band2-15MHz-QPSK-18675-75RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

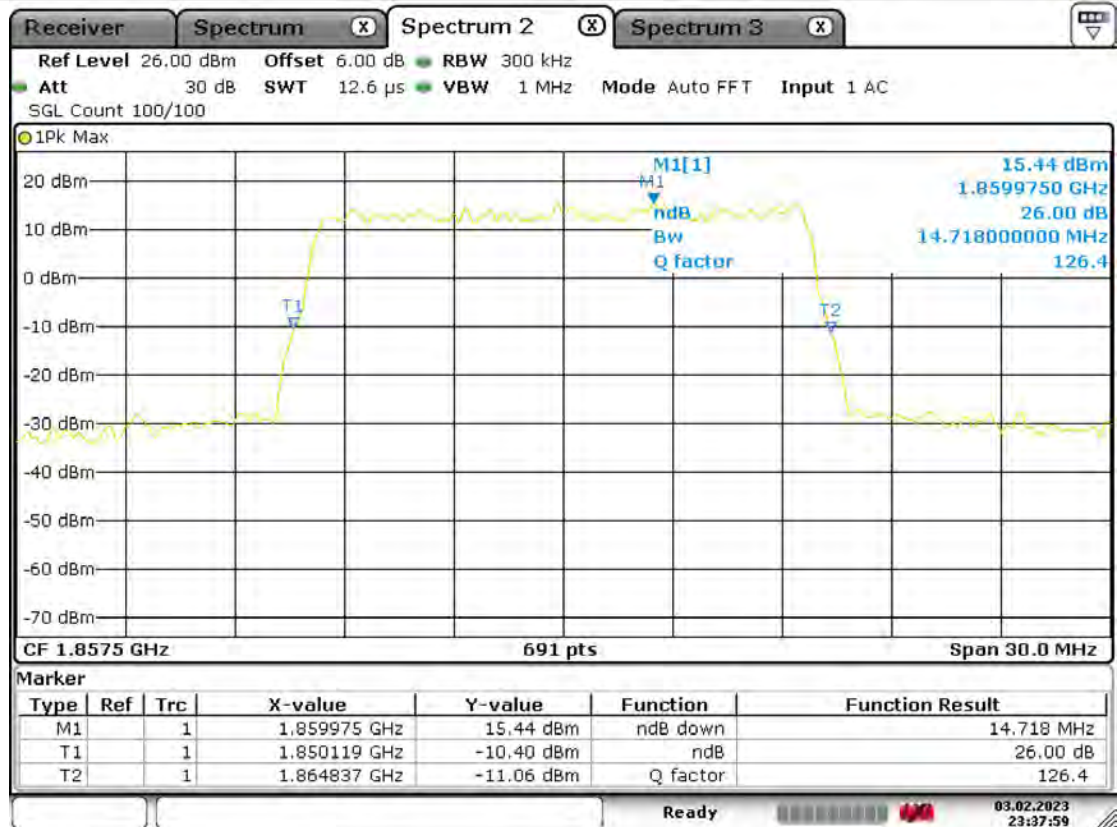


Date: 3.FEB.2023 23:37:59

Band2-15MHz-QPSK-18900-75RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

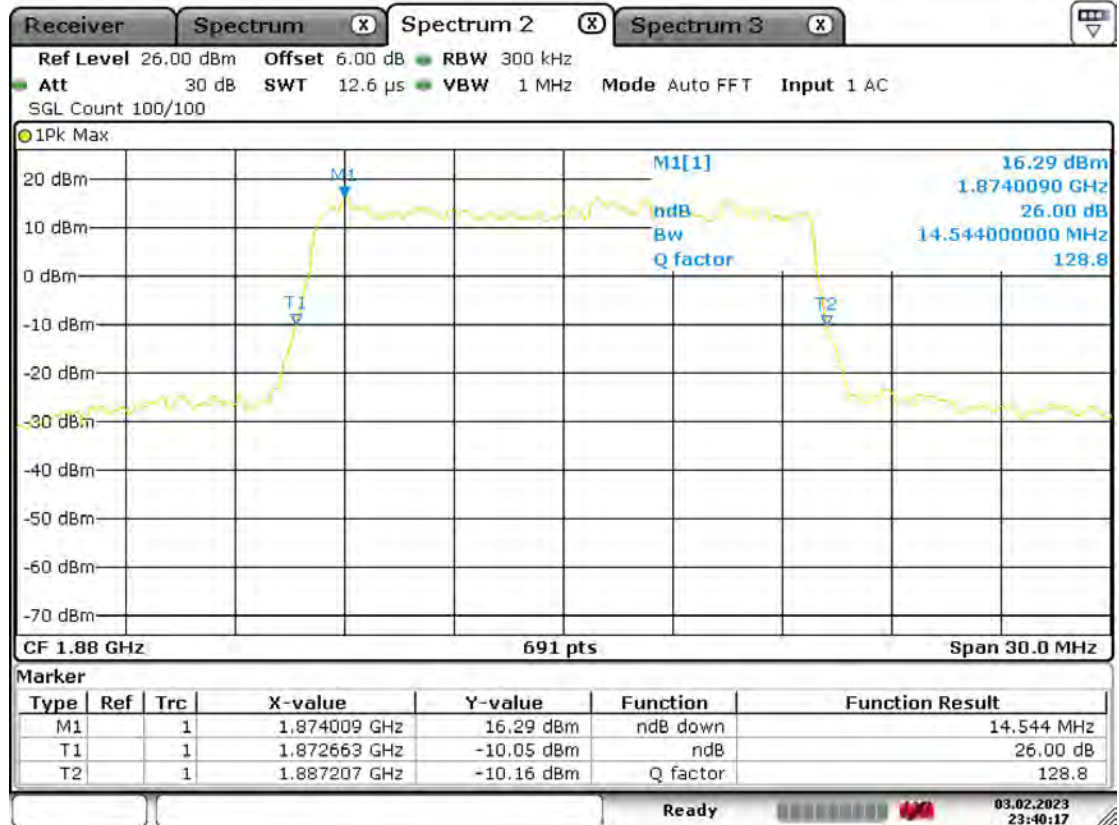


Date: 3.FEB.2023 23:40:17

Band2-15MHz-QPSK-19125-75RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

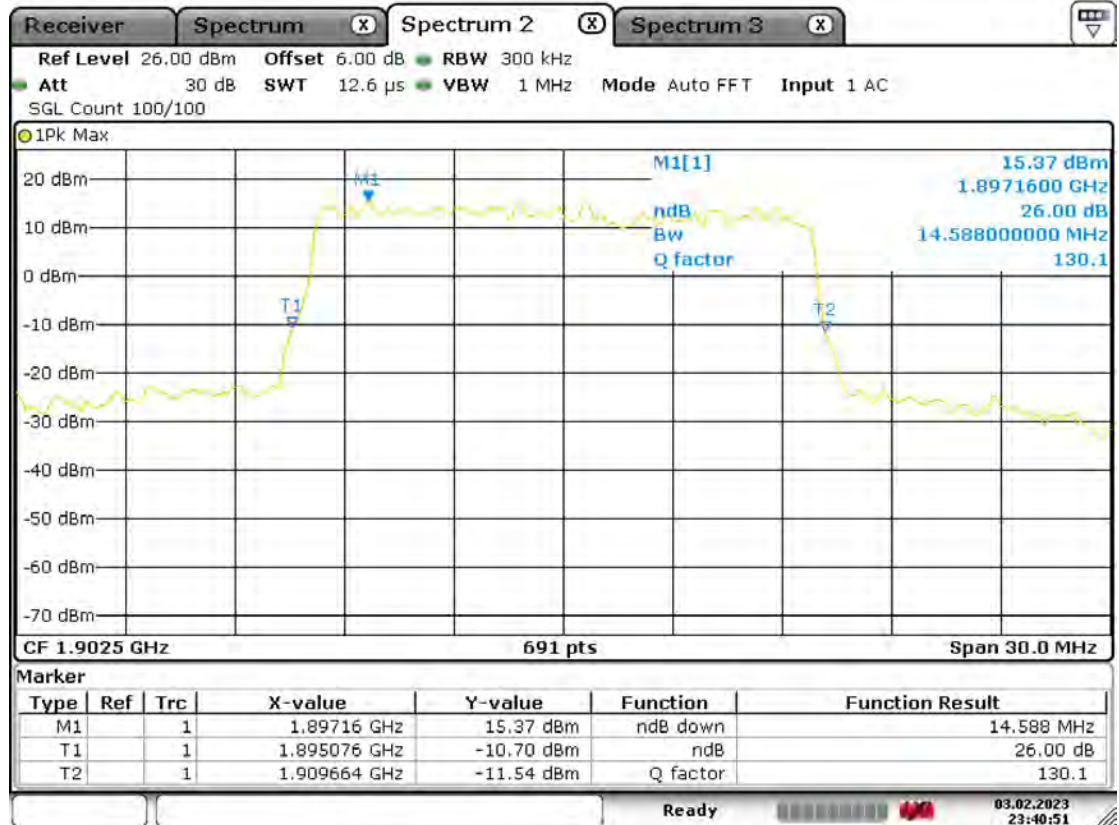


Date: 3.FEB.2023 23:40:50

Band2-15MHz-16QAM-18675-75RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

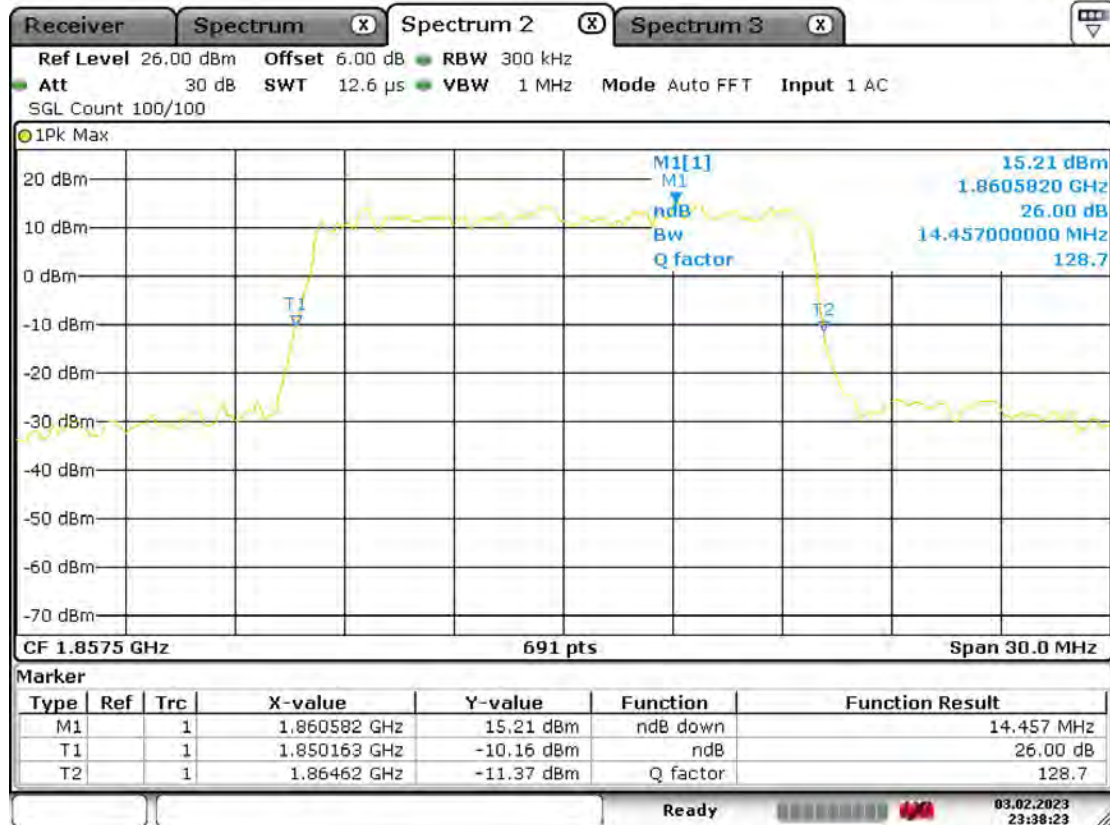


Date: 3.FEB.2023 23:38:23

Band2-15MHz-16QAM-18900-75RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

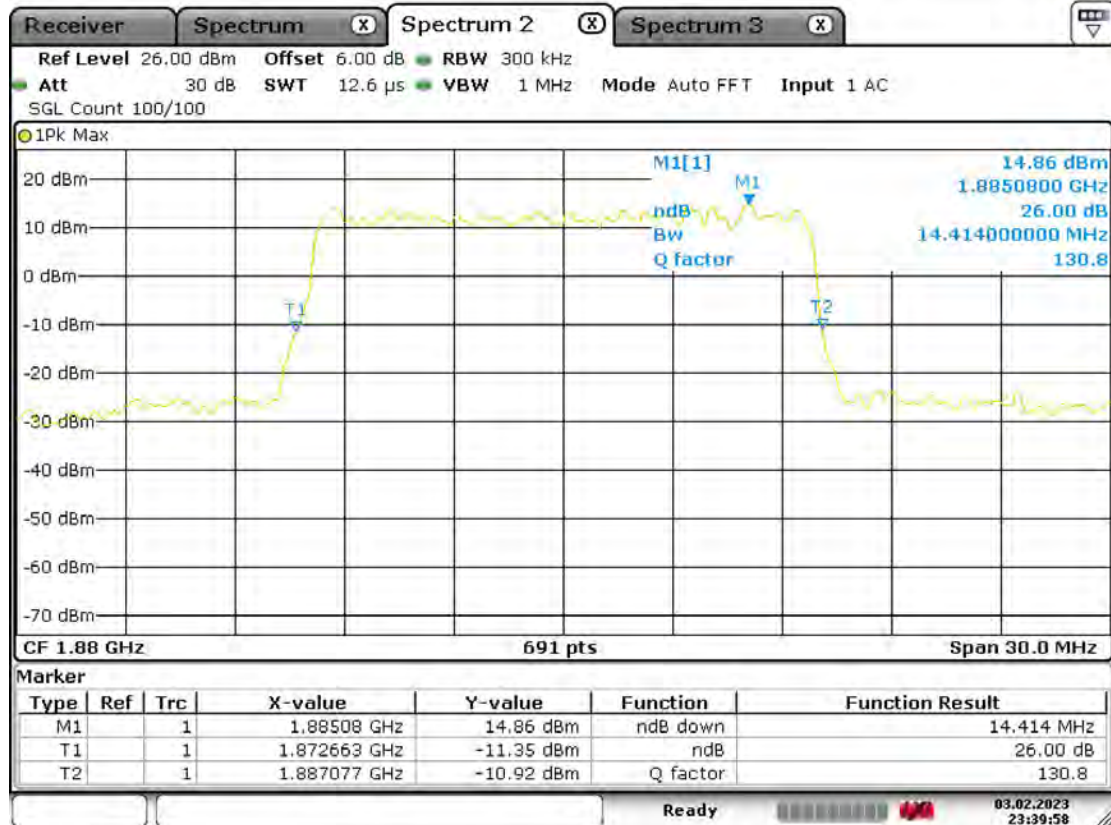


Date: 3.FEB.2023 23:39:58

Band2-15MHz-16QAM-19125-75RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

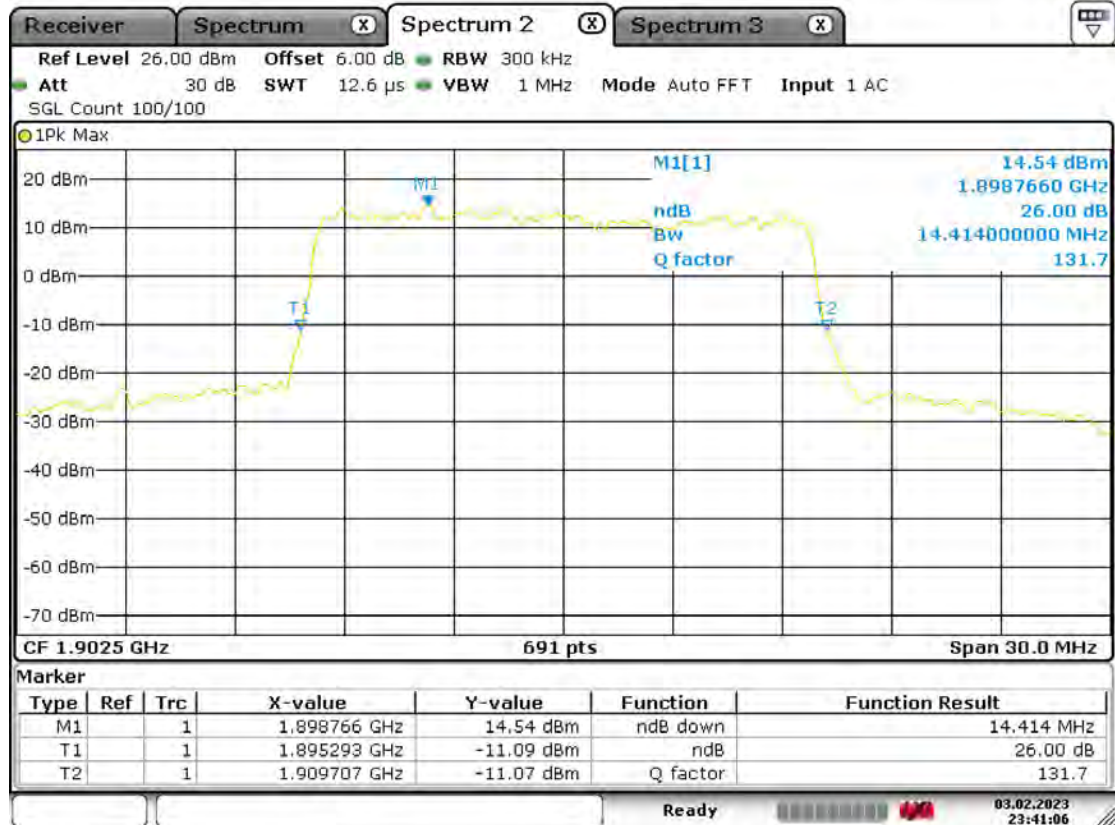


Date: 3.FEB.2023 23:41:05

Band2-20MHz-QPSK-18700-100RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

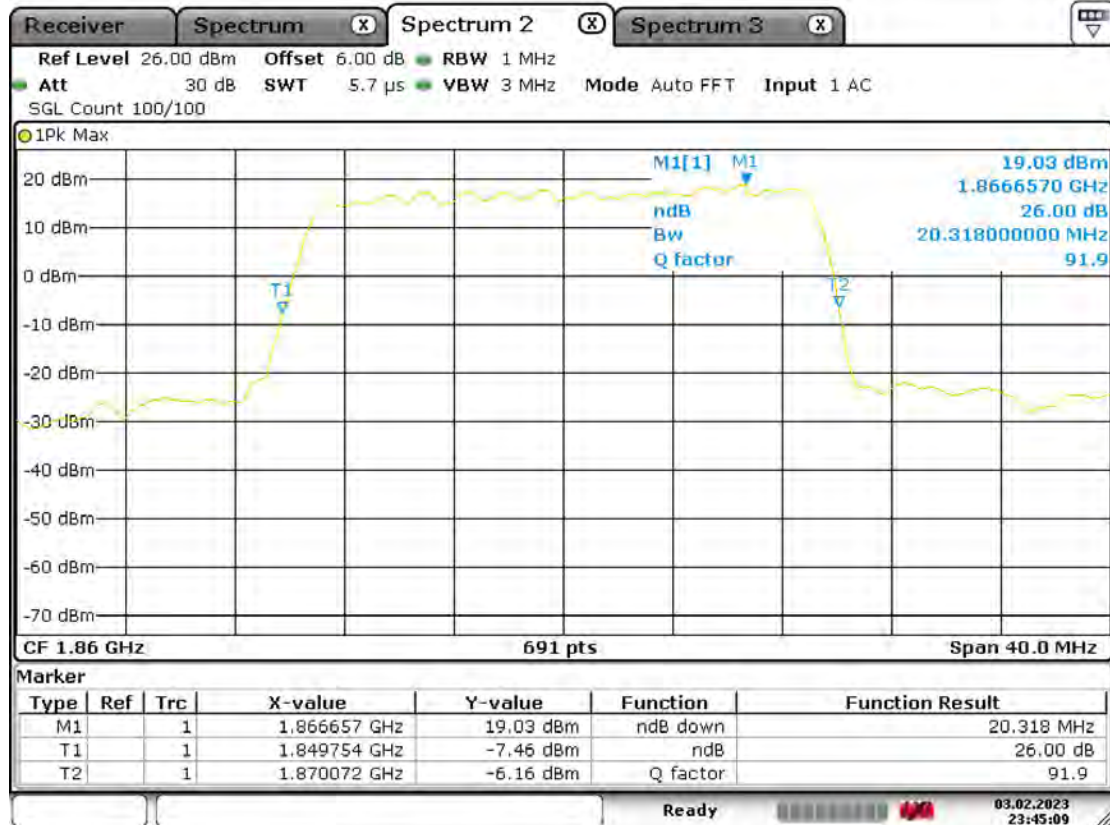


Date: 3.FEB.2023 23:45:09

Band2-20MHz-QPSK-18900-100RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

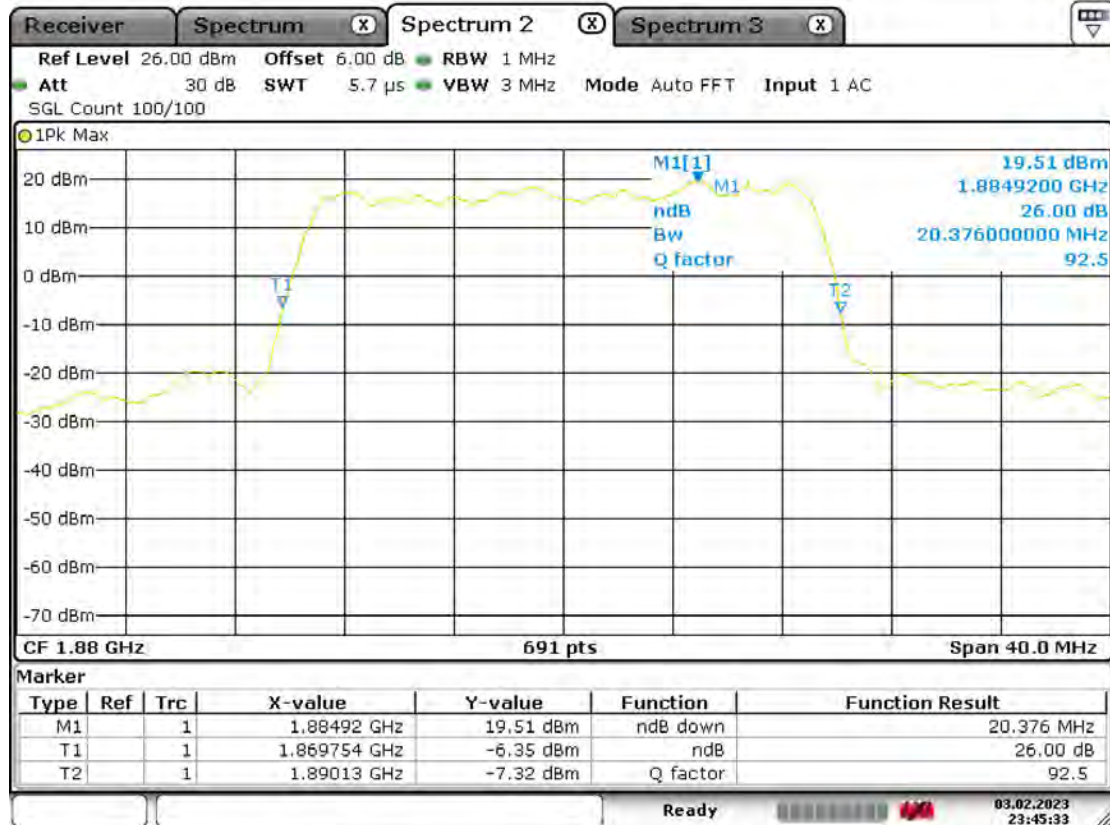


Date: 3.FEB.2023 23:45:32

Band2-20MHz-QPSK-19100-100RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

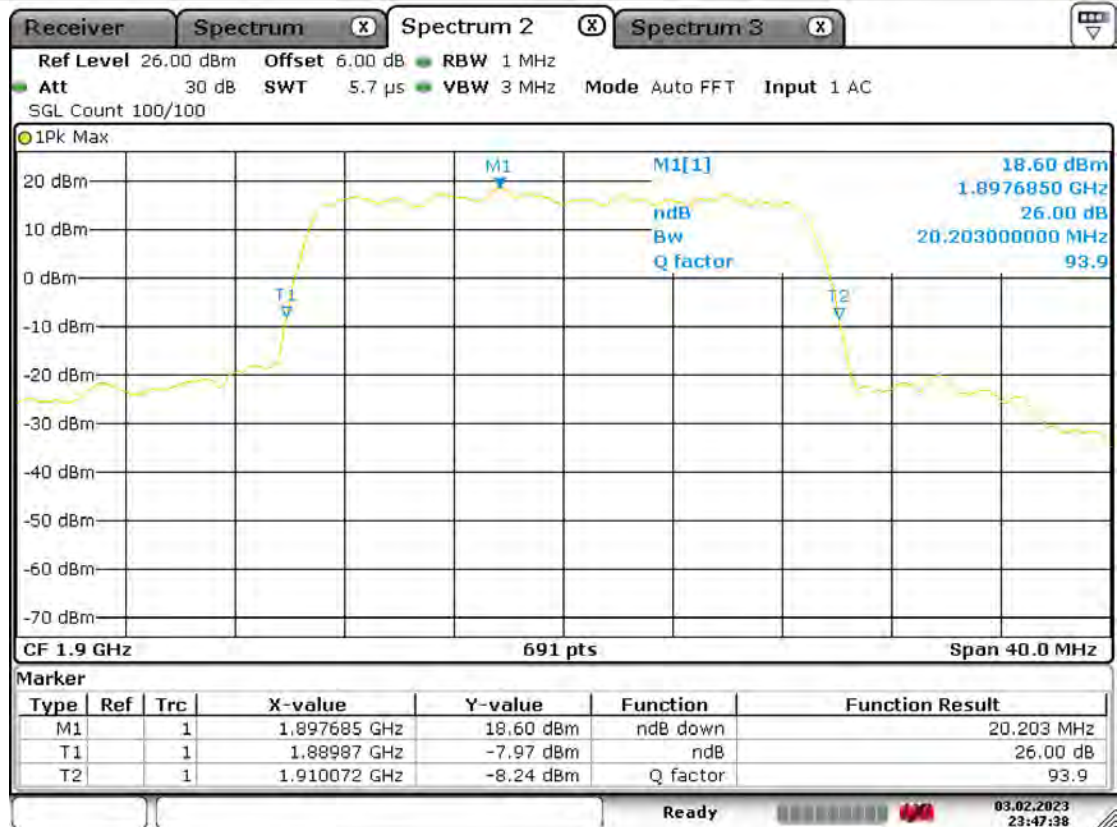


Date: 3.FEB.2023 23:47:38

Band2-20MHz-16QAM-18700-100RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

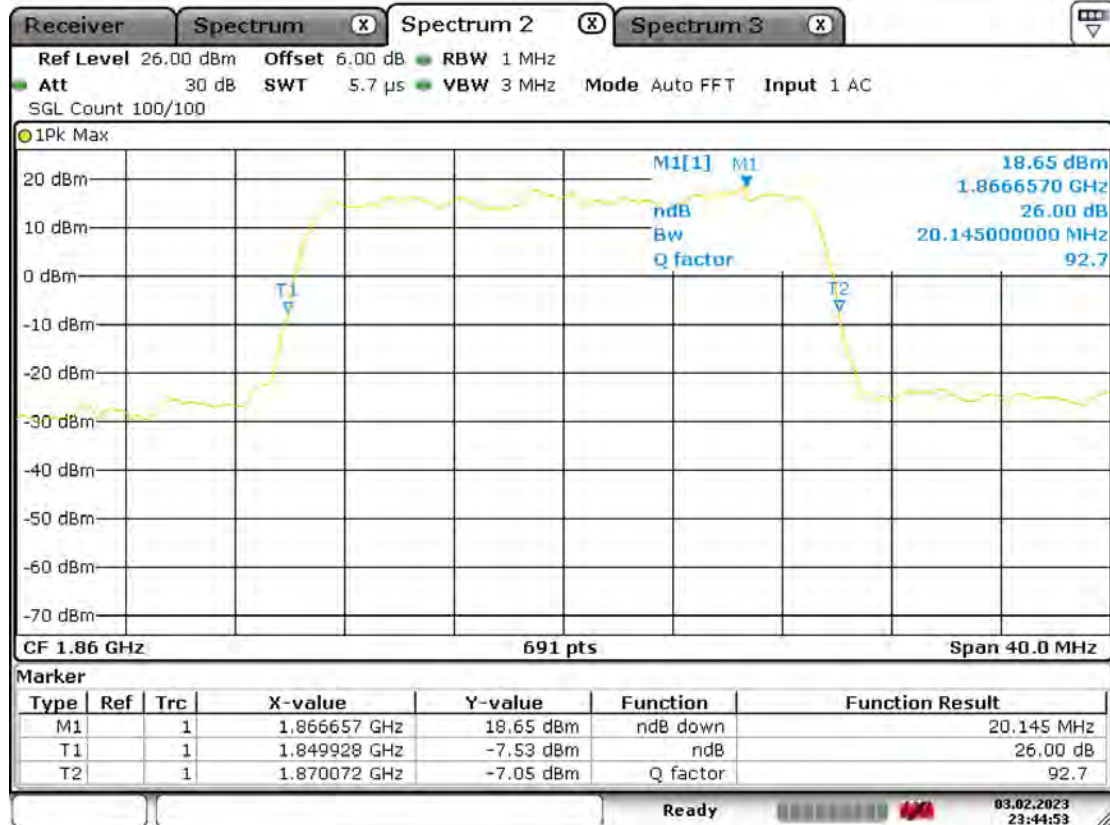


Date: 3.FEB.2023 23:44:52

Band2-20MHz-16QAM-18900-100RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

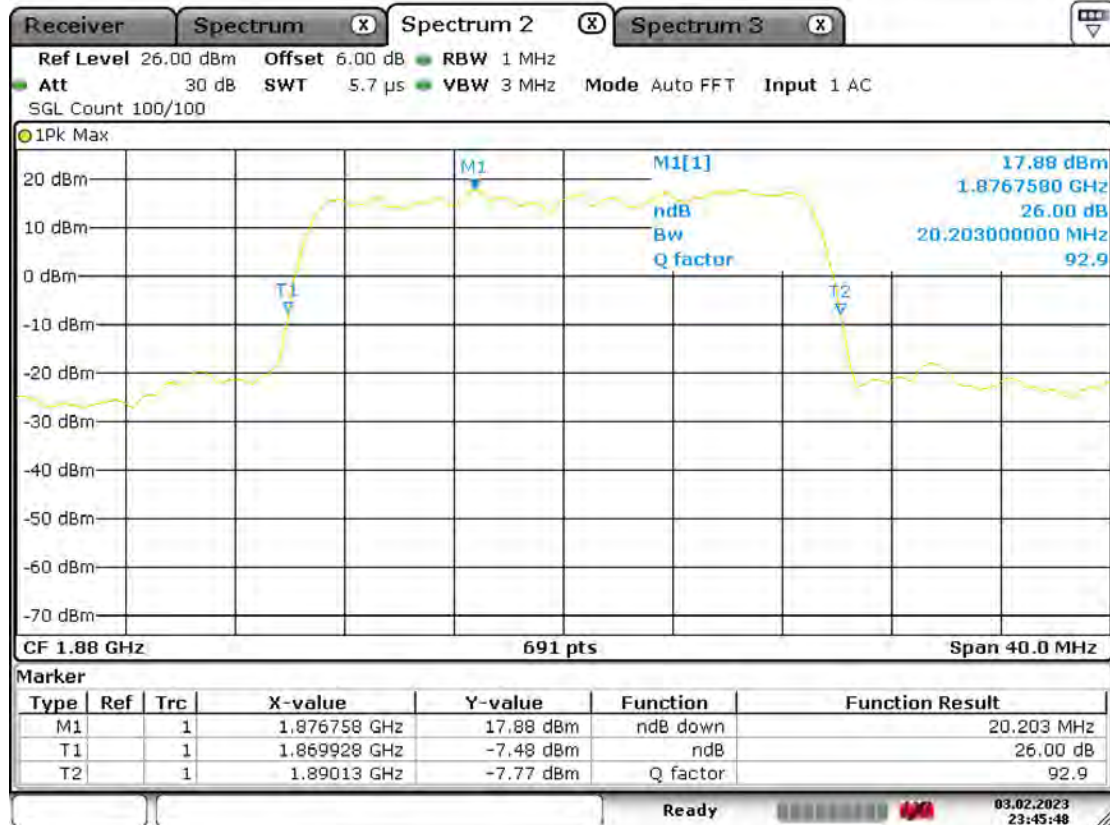


Date: 3.FEB.2023 23:45:47

Band2-20MHz-16QAM-19100-100RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

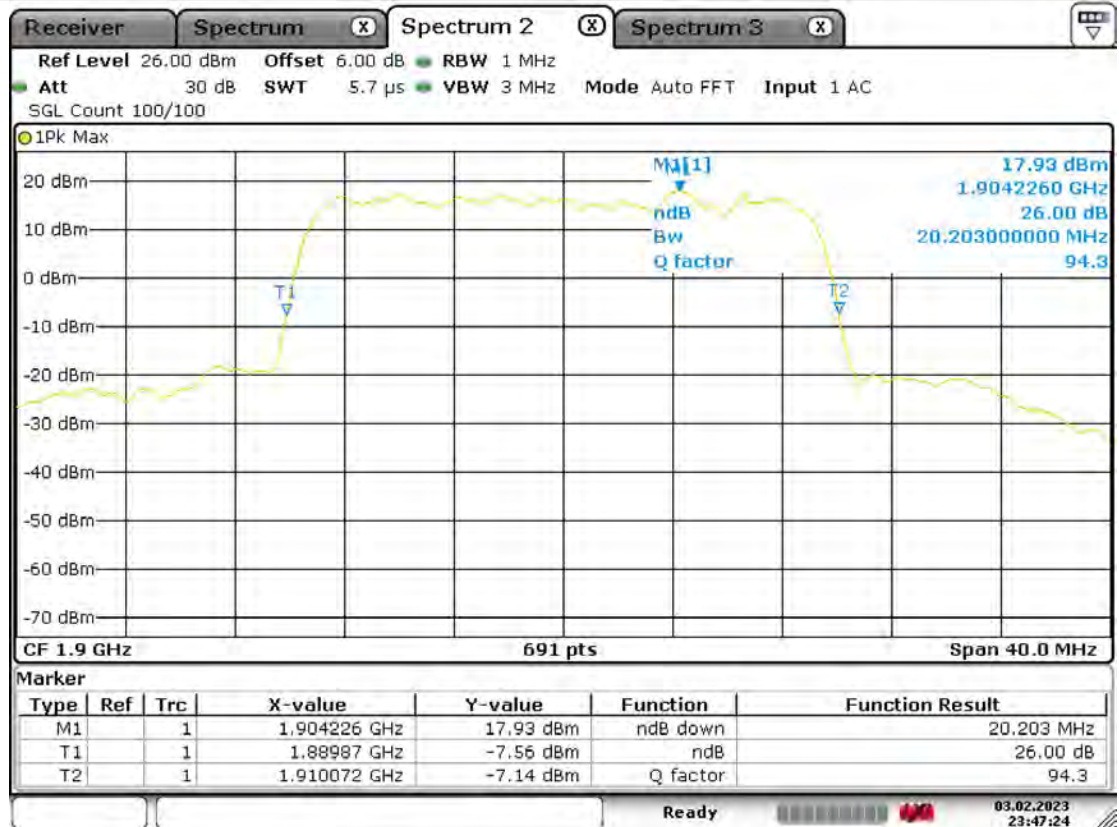


Date: 3.FEB.2023 23:47:24

Band2-1.4MHz-64QPSK-18607-6RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

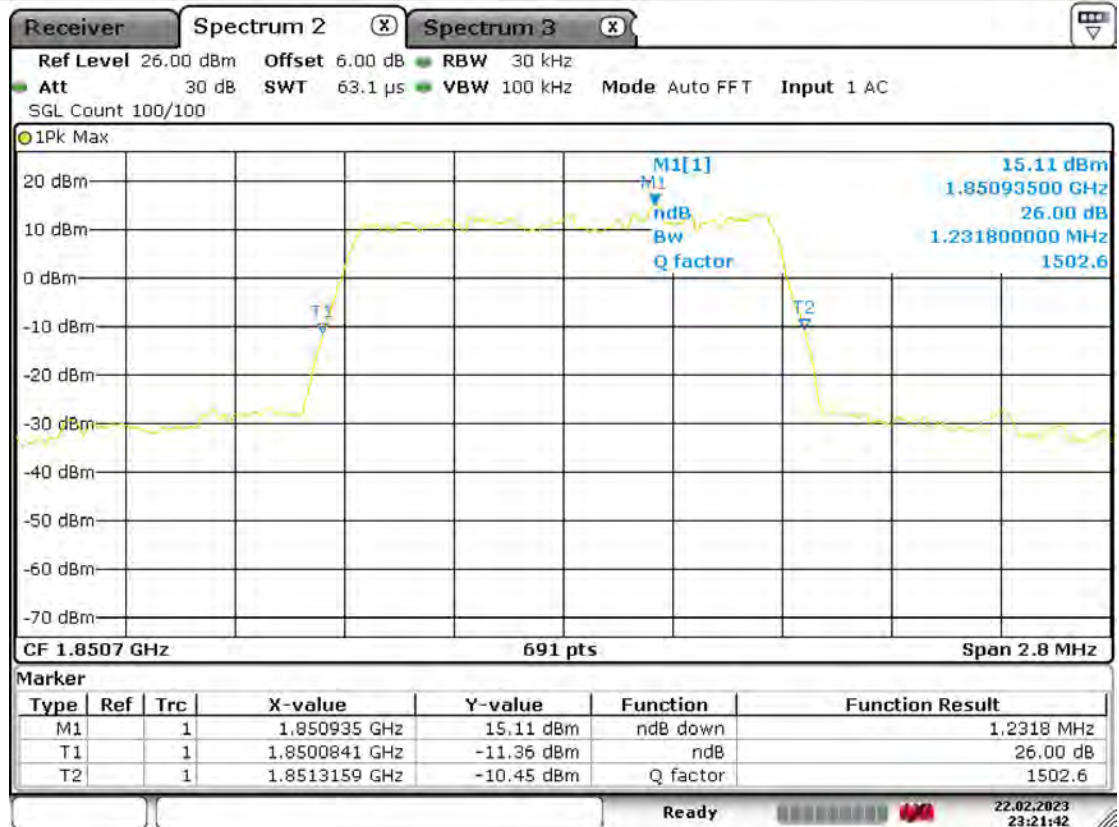


Date: 22.FEB.2023 23:21:42

Band2-1.4MHz-64QPSK-18900-6RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

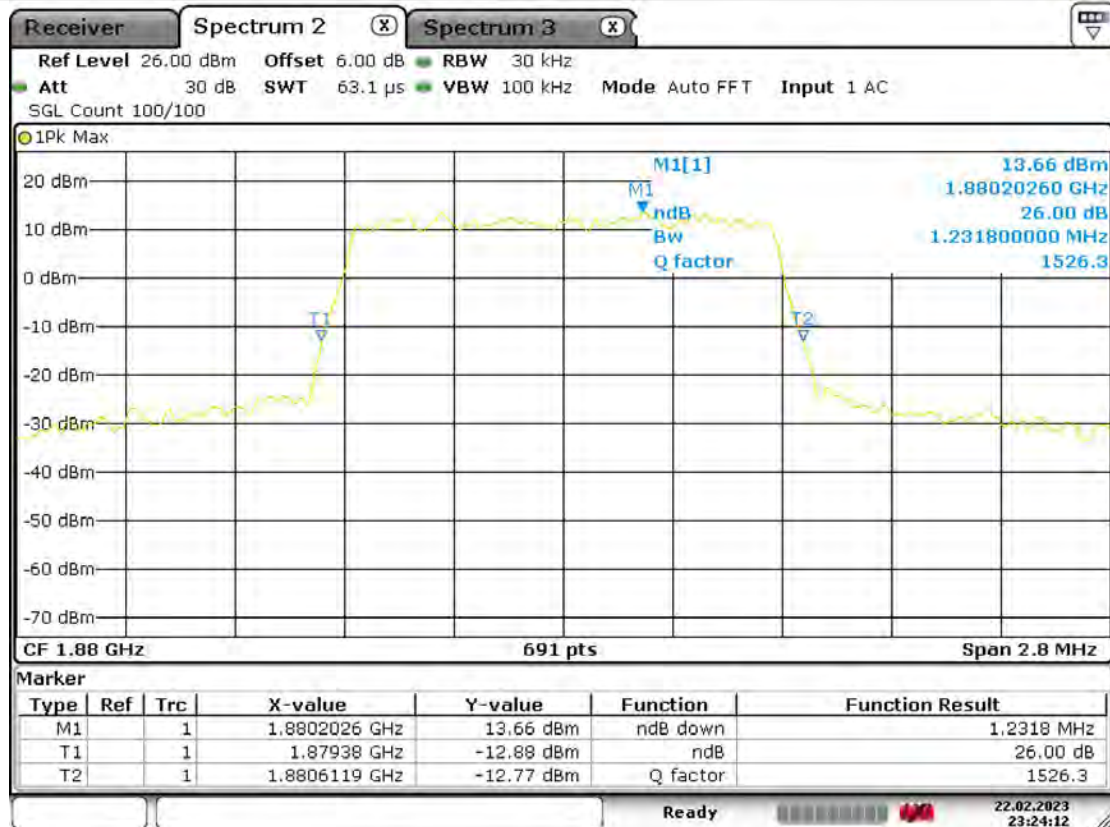


Date: 22.FEB.2023 23:24:12

Band2-1.4MHz-64QPSK-19193-6RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

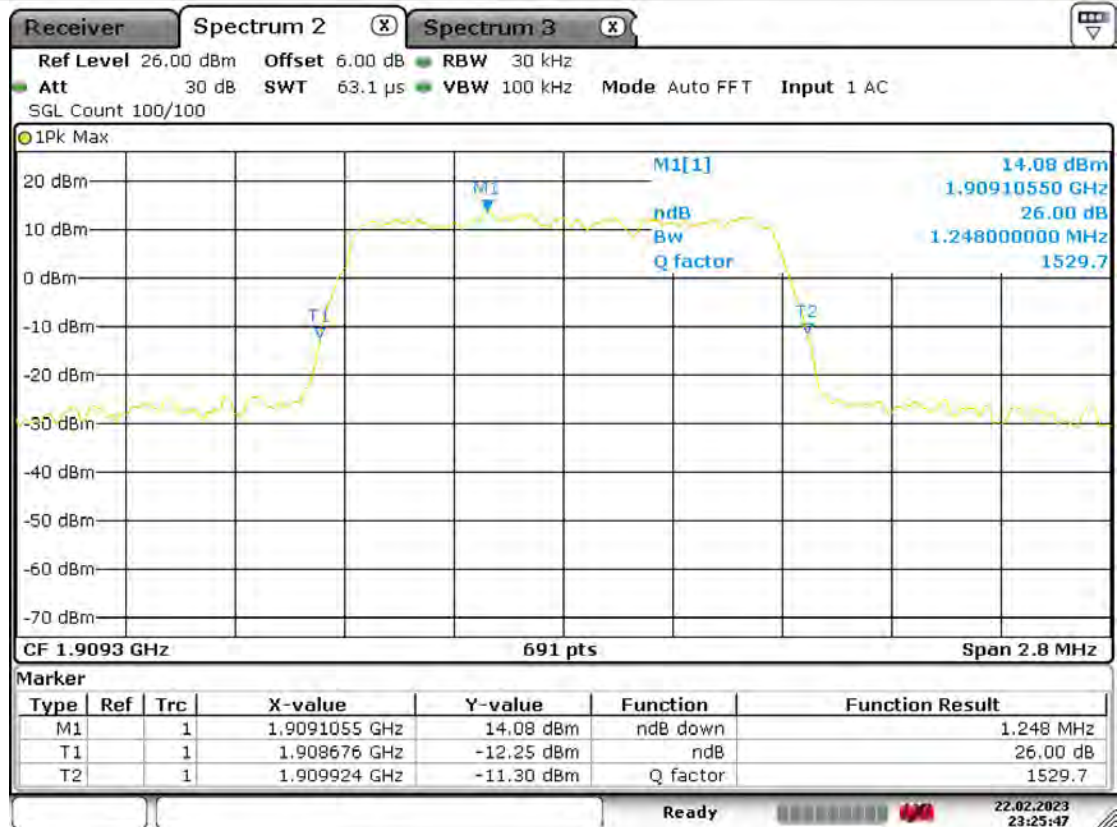


Date: 22.FEB.2023 23:25:47

Band2-3MHz-64QPSK-18615-6RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

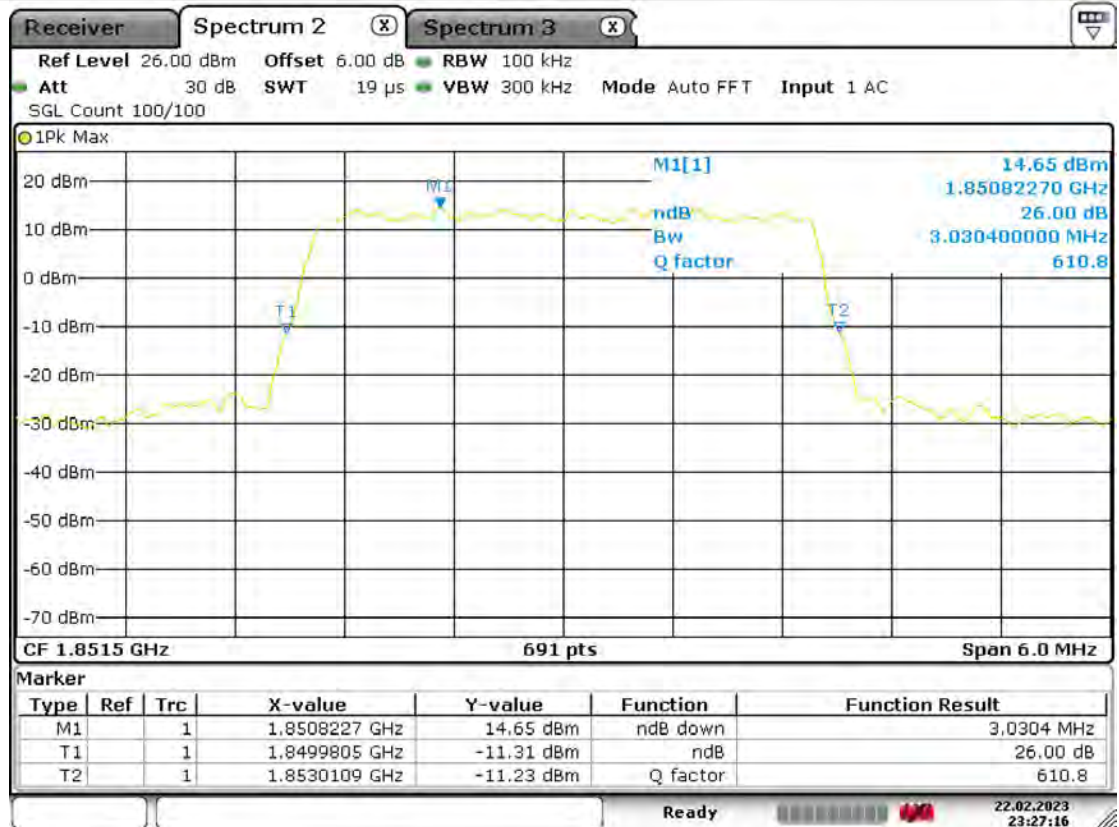


Date: 22.FEB.2023 23:27:16

Band2-3MHz-64QPSK-18900-6RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

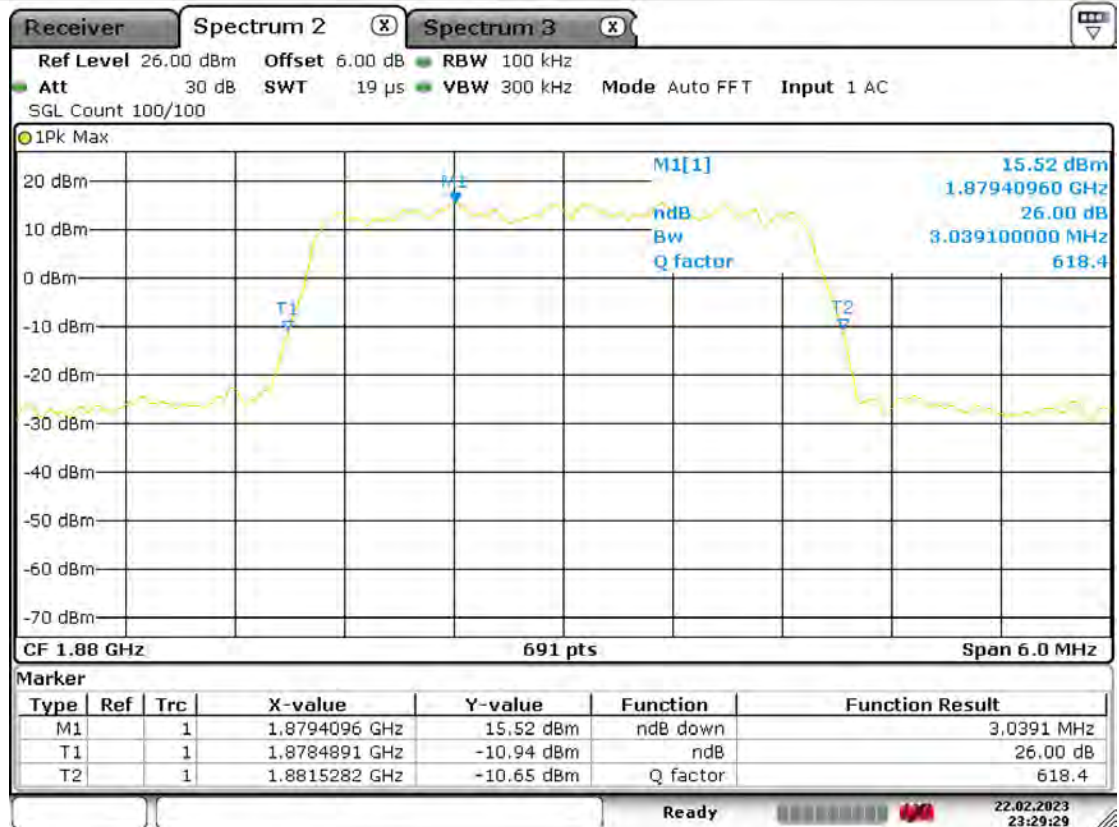


Date: 22.FEB.2023 23:29:29

Band2-3MHz-64QPSK-19185-6RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

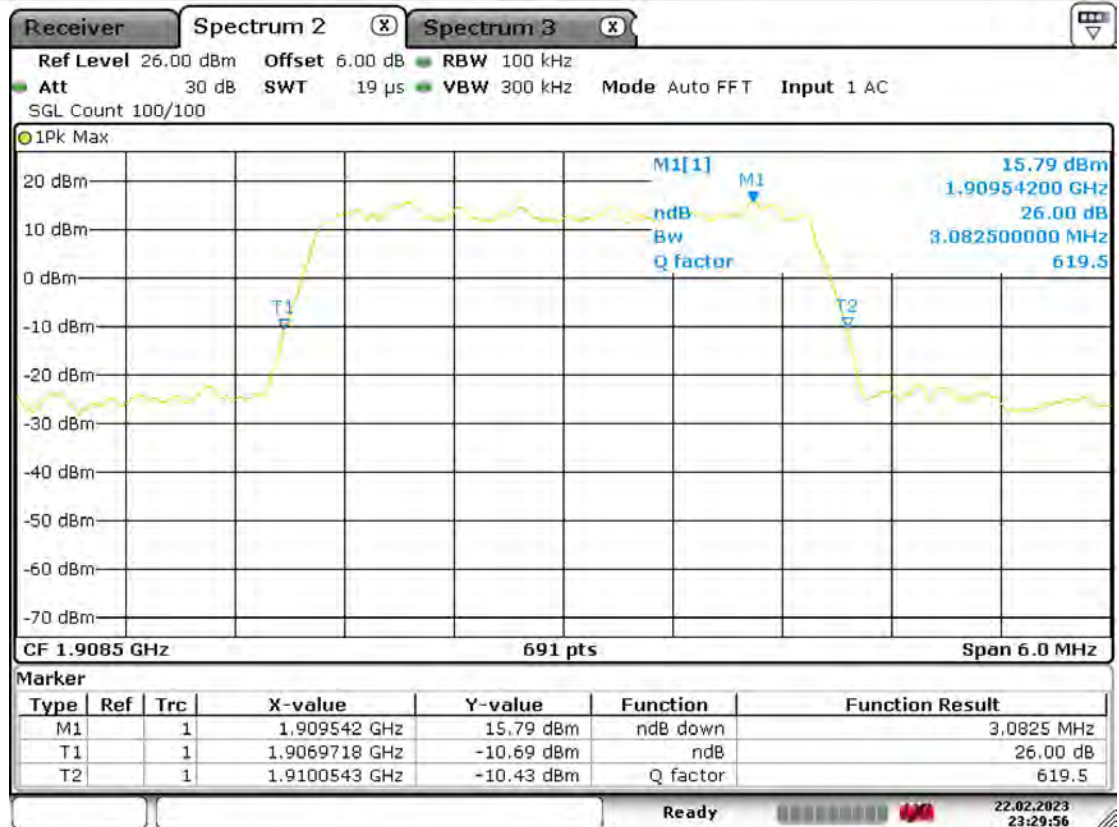


Date: 22.FEB.2023 23:29:56

Band2-5MHz-64QPSK-18625-6RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

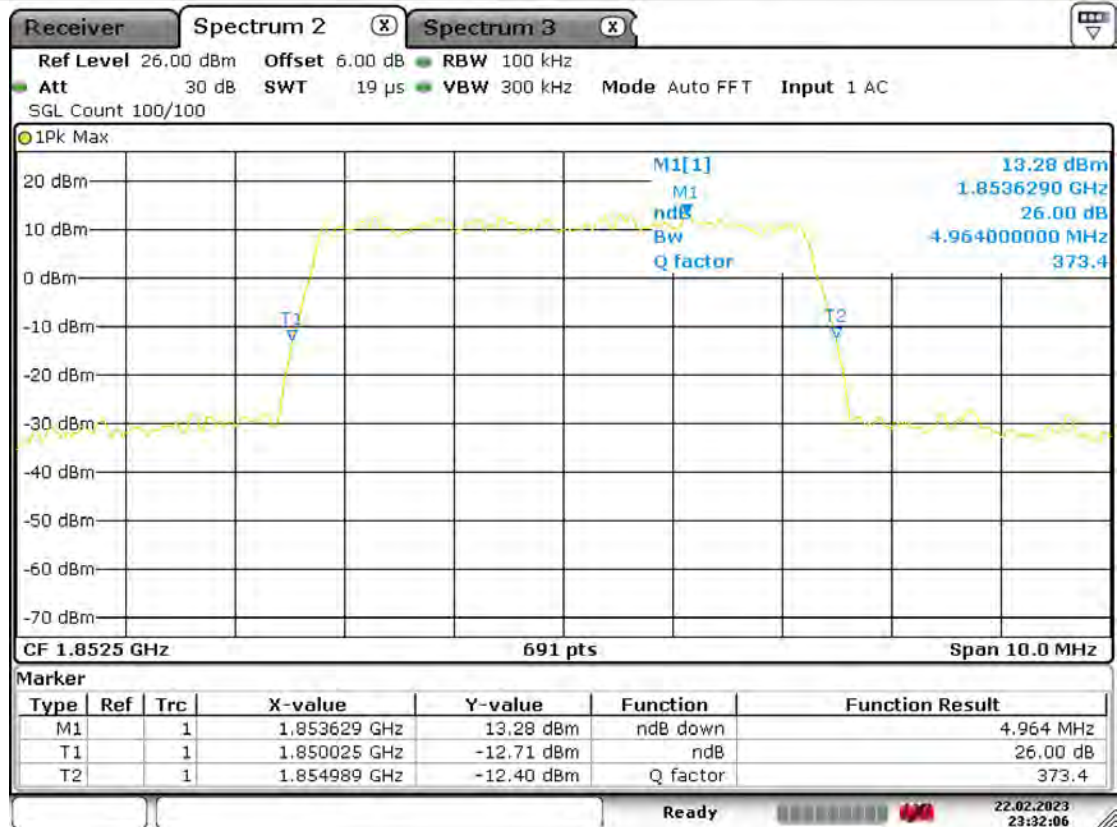


Date: 22.FEB.2023 23:32:06

Band2-5MHz-64QPSK-18900-6RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

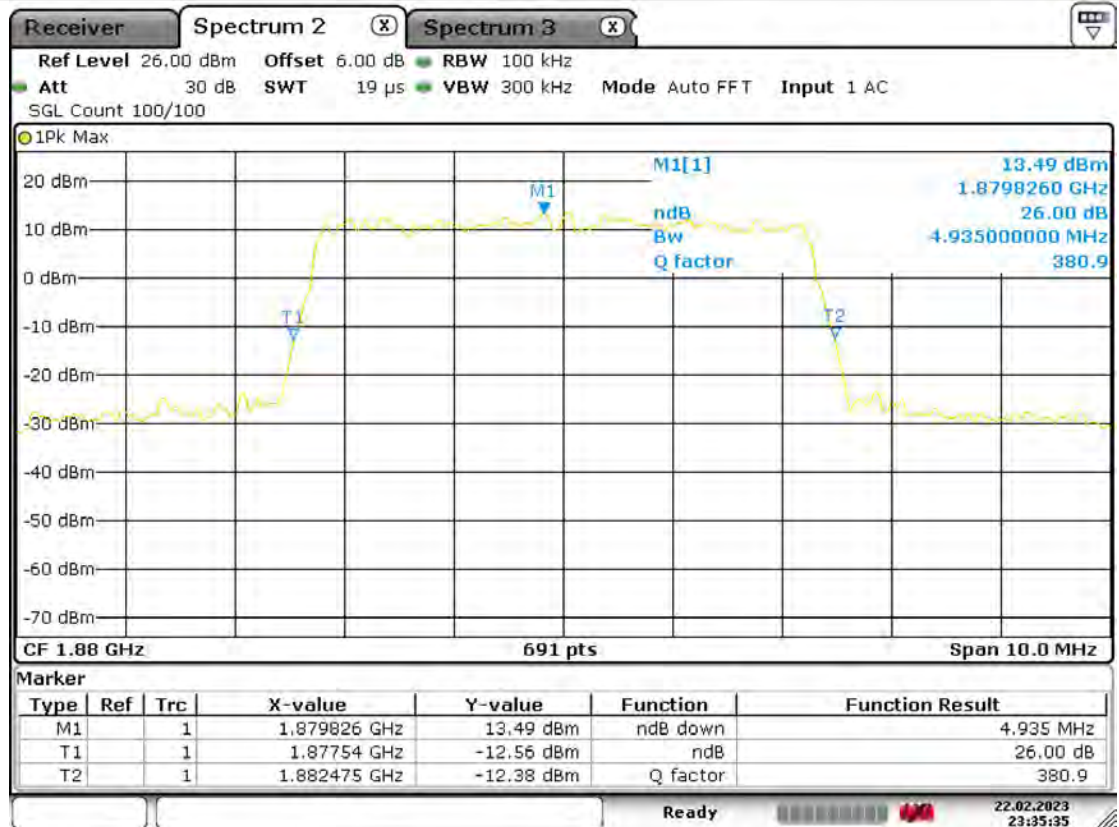


Date: 22.FEB.2023 23:35:35

Band2-5MHz-64QPSK-19175-6RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

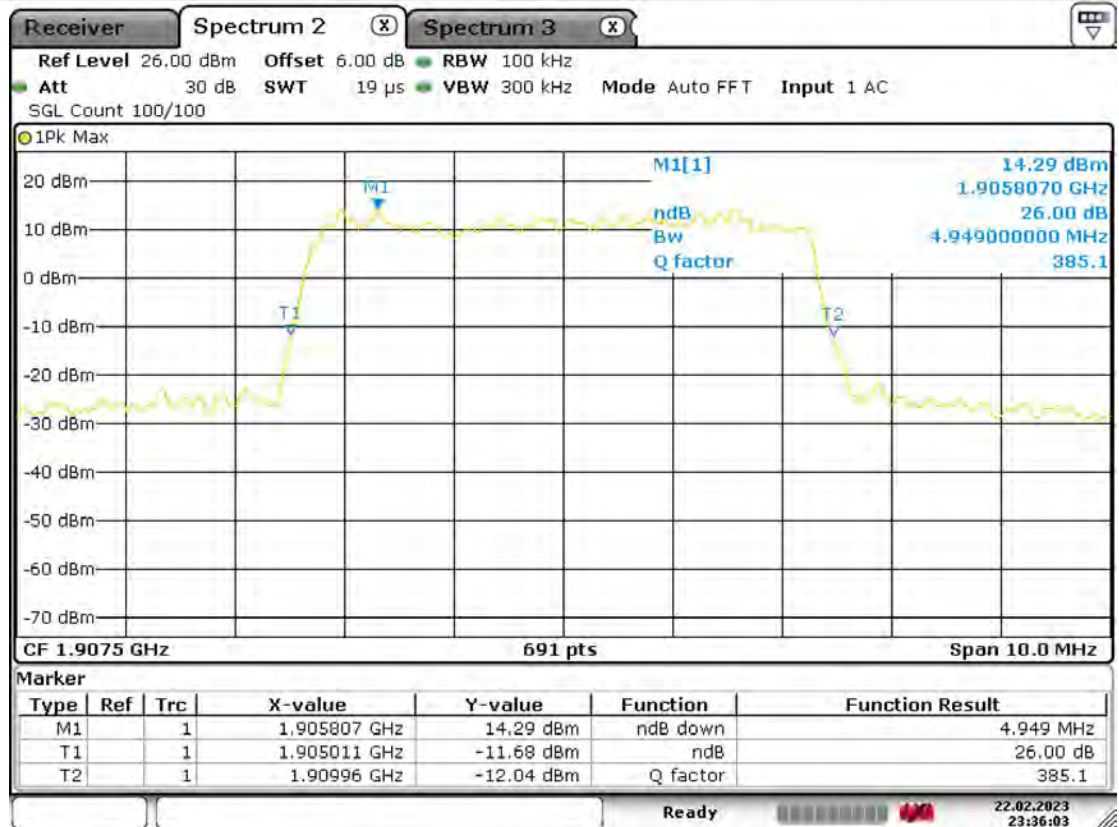


Date: 22.FEB.2023 23:36:03

Band2-10MHz-64QPSK-18650-6RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

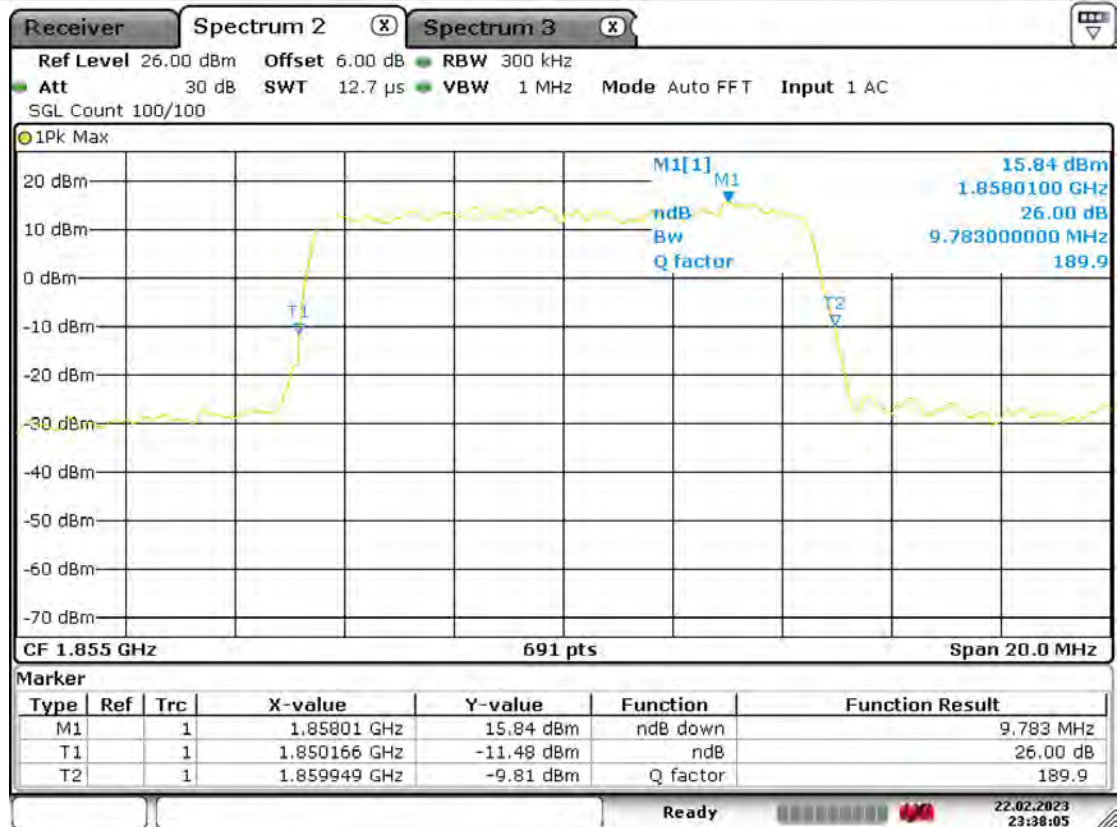


Date: 22.FEB.2023 23:38:05

Band2-10MHz-64QPSK-18900-6RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

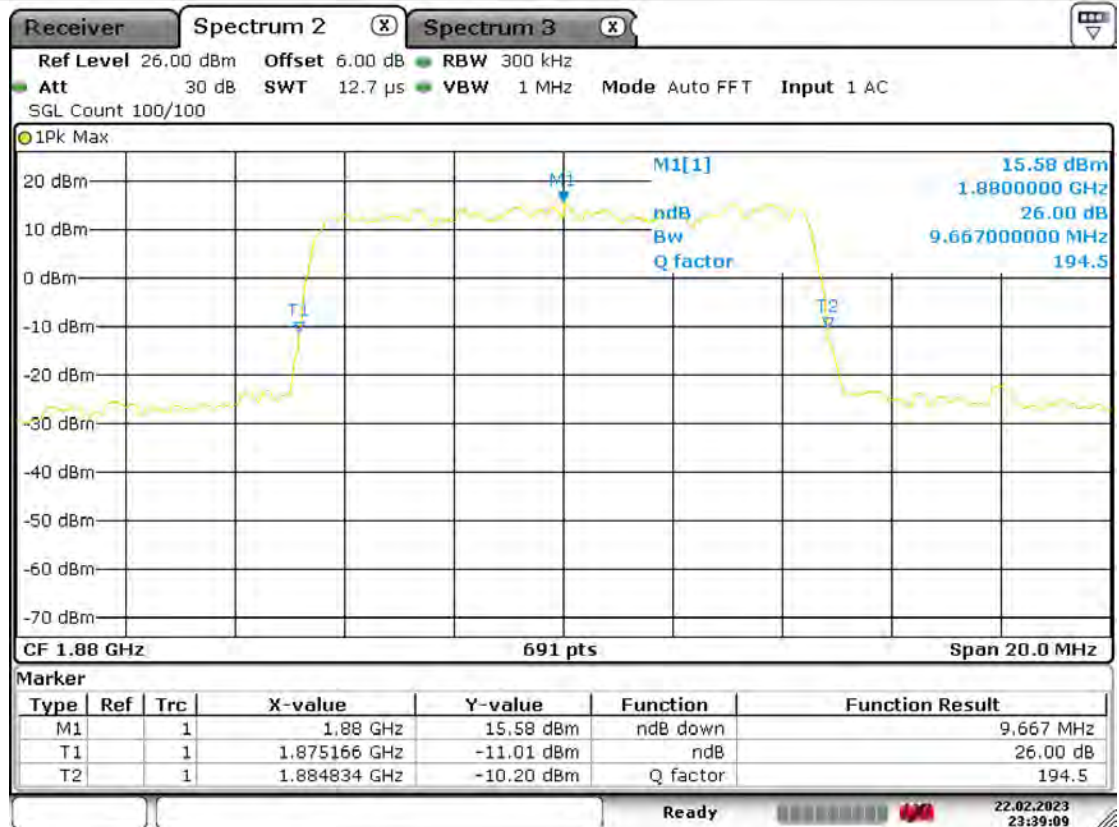


Date: 22.FEB.2023 23:39:09

Band2-10MHz-64QPSK-19150-6RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

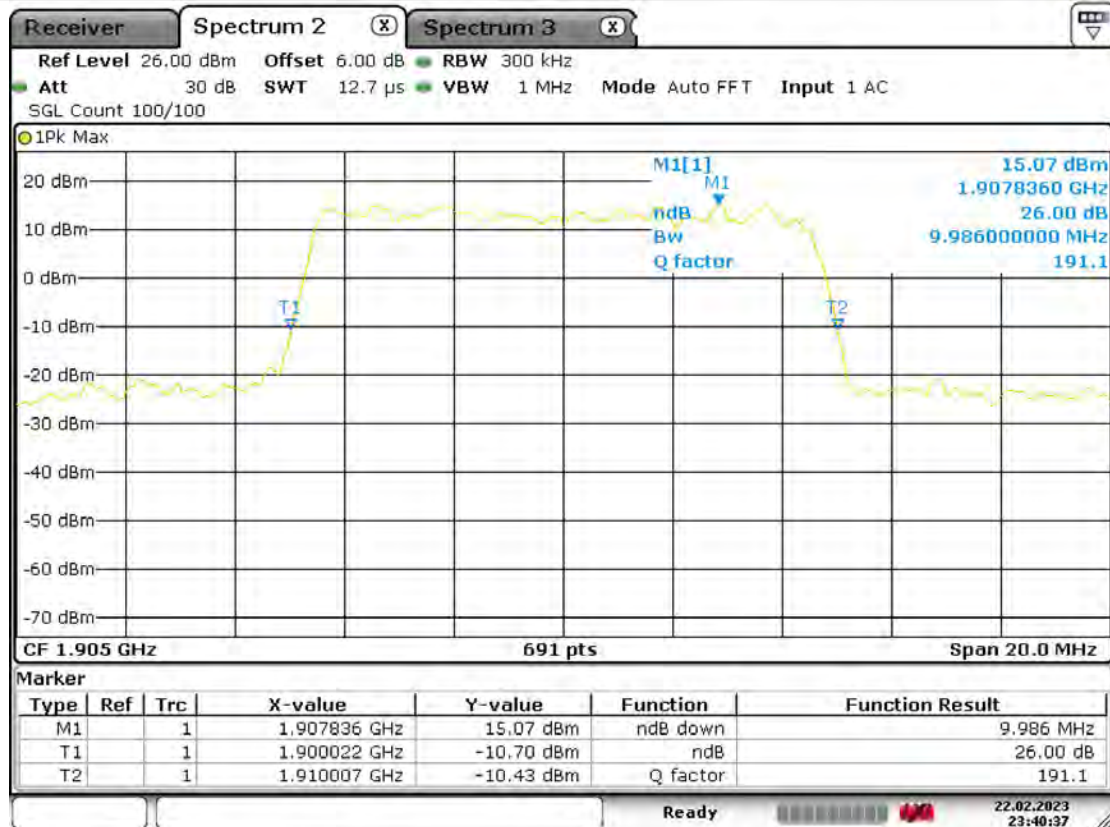


Date: 22.FEB.2023 23:40:37

Band2-15MHz-64QPSK-18675-6RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

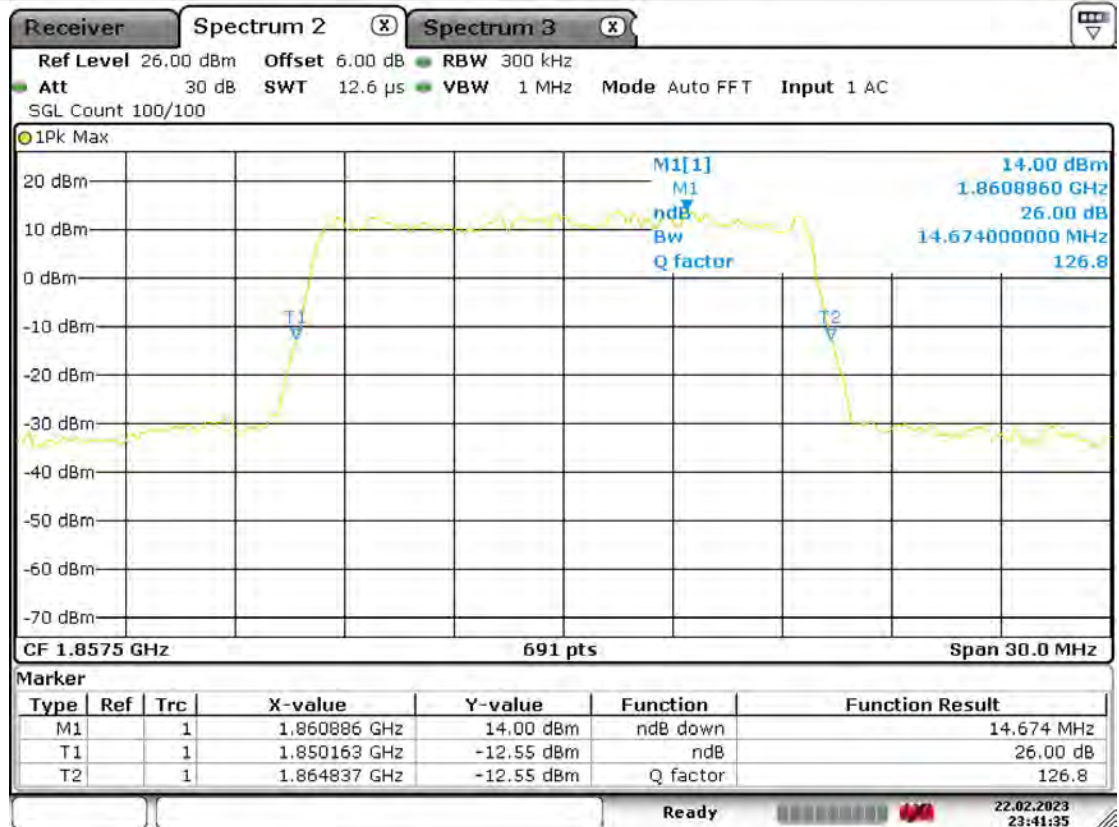


Date: 22.FEB.2023 23:41:35

Band2-15MHz-64QPSK-18900-6RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

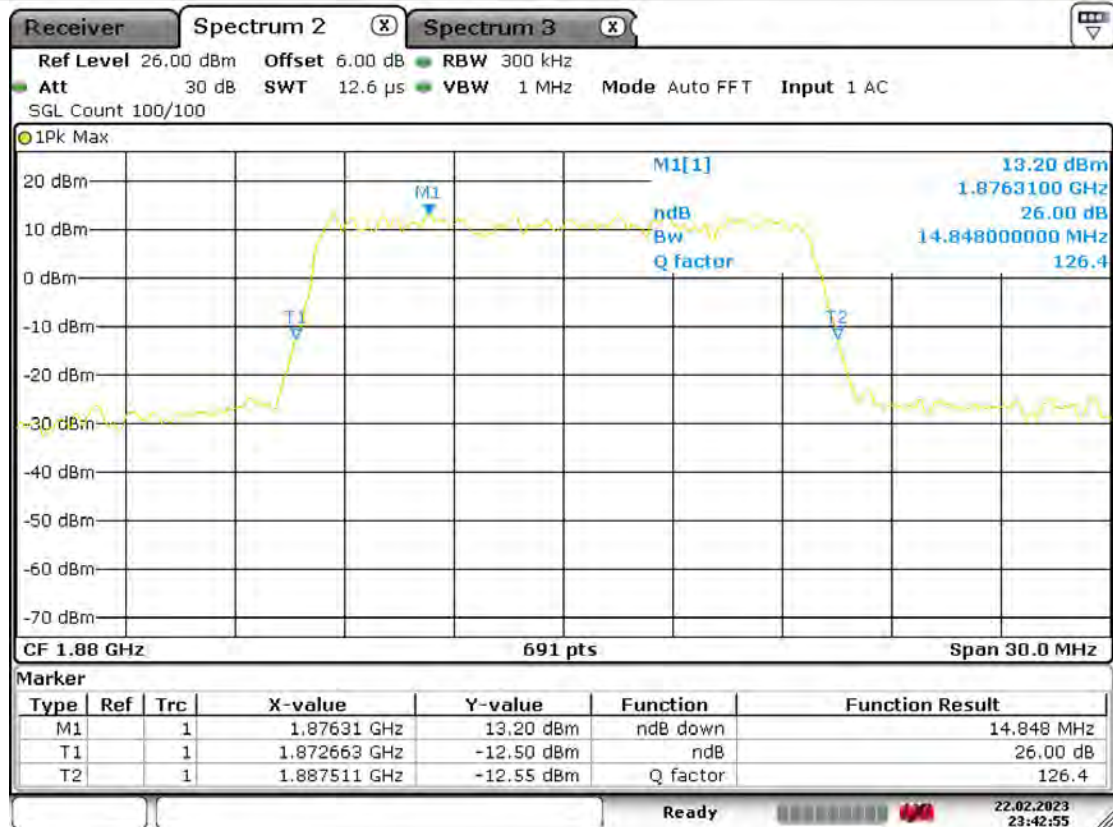


Date: 22.FEB.2023 23:42:55

Band2-15MHz-64QPSK-19125-6RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

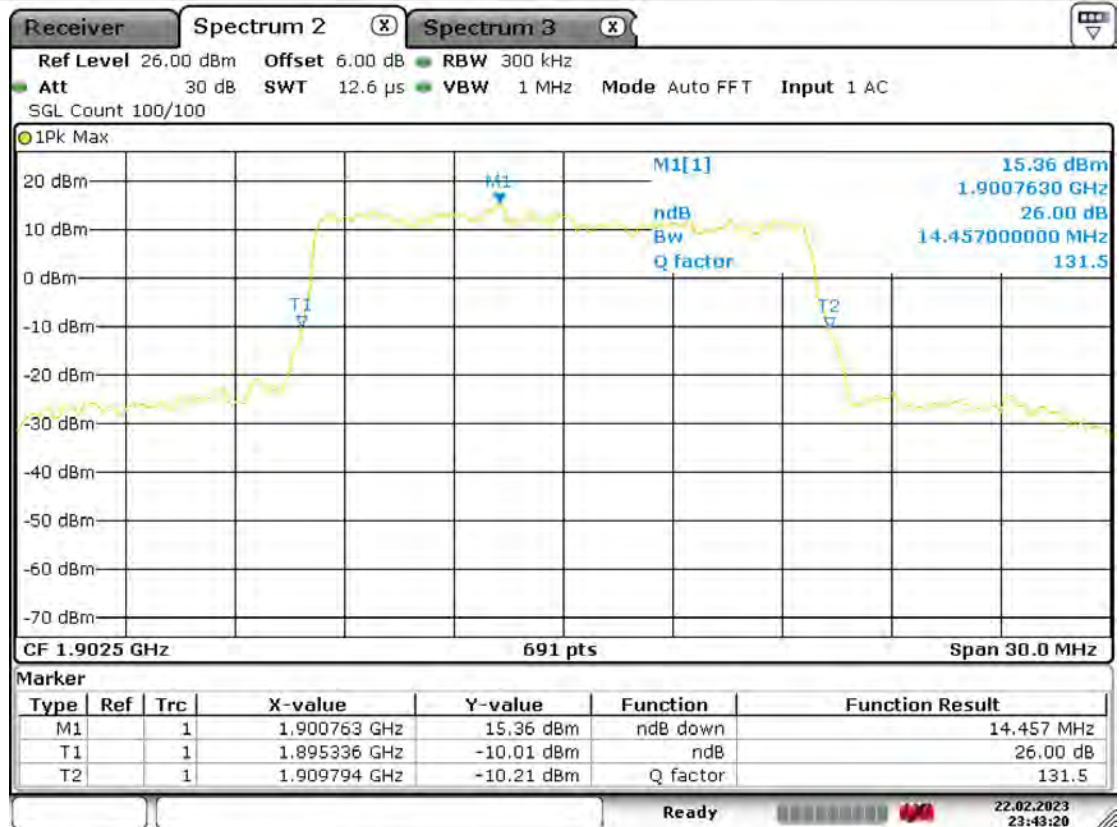


Date: 22.FEB.2023 23:43:20

Band2-20MHz-64QPSK-18700-6RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

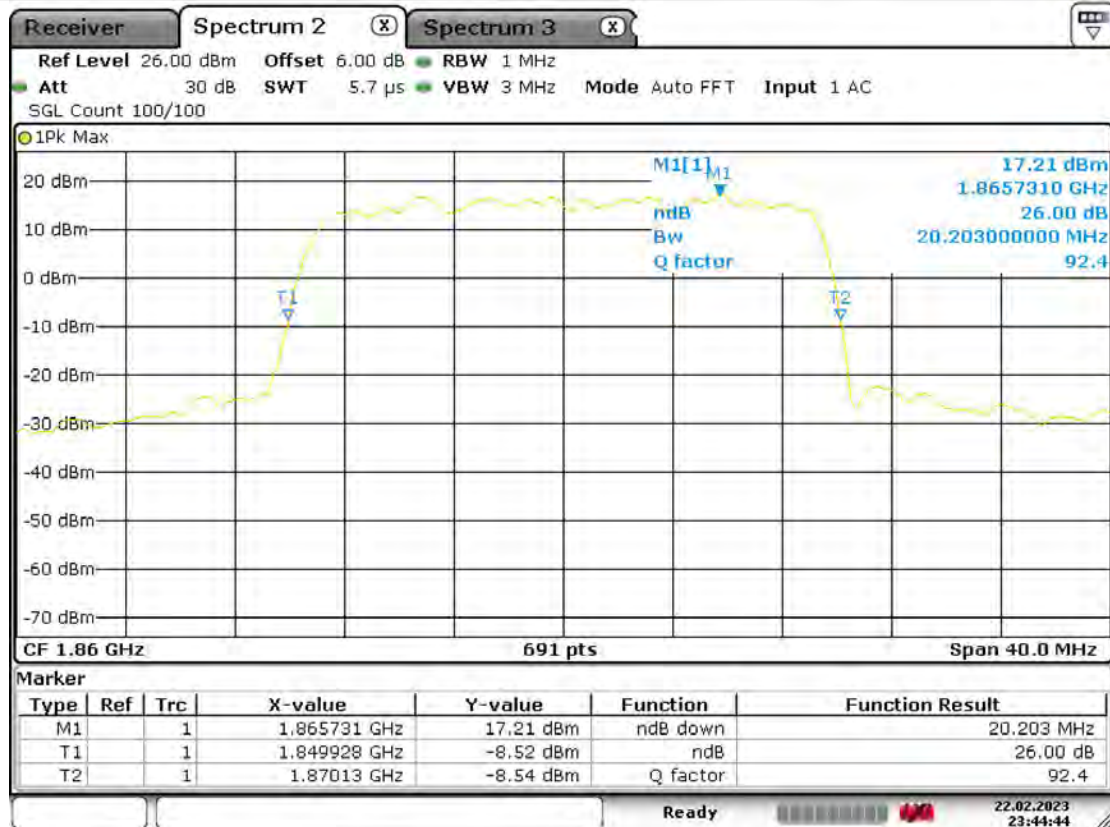


Date: 22.FEB.2023 23:44:44

Band2-20MHz-64QPSK-18900-6RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

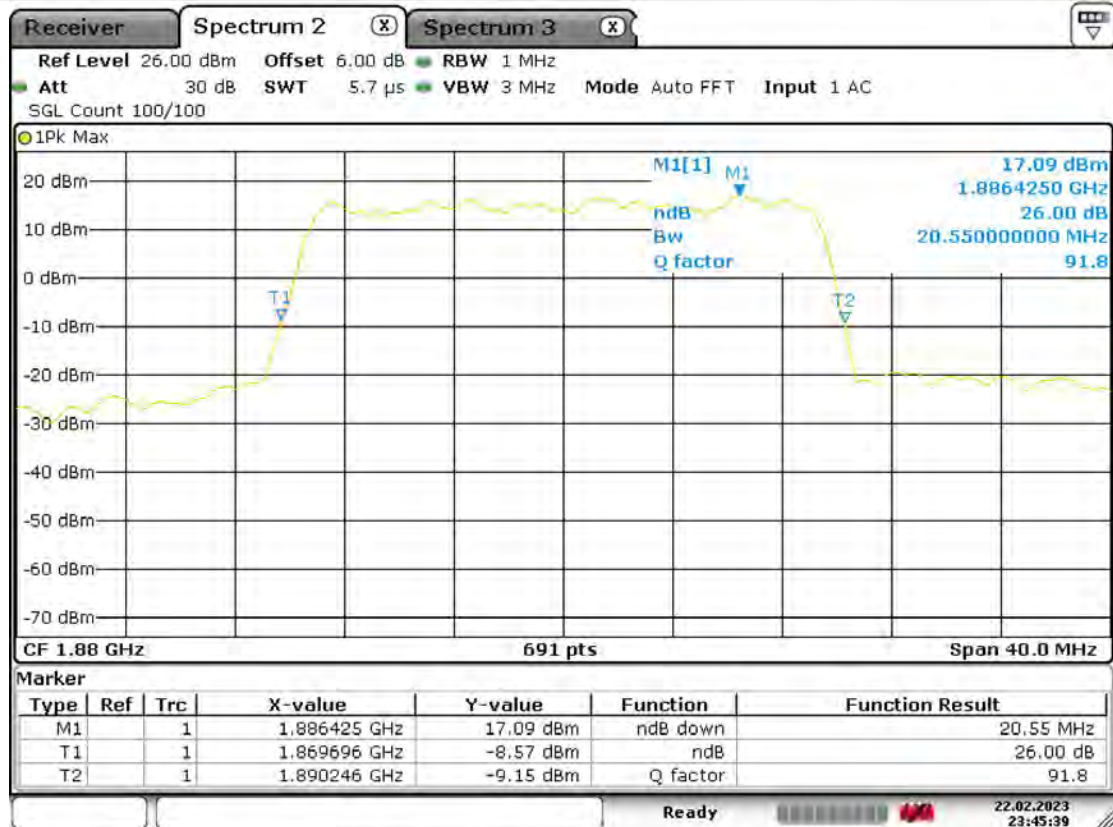


Date: 22.FEB.2023 23:45:39

Band2-20MHz-64QPSK-19100-6RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

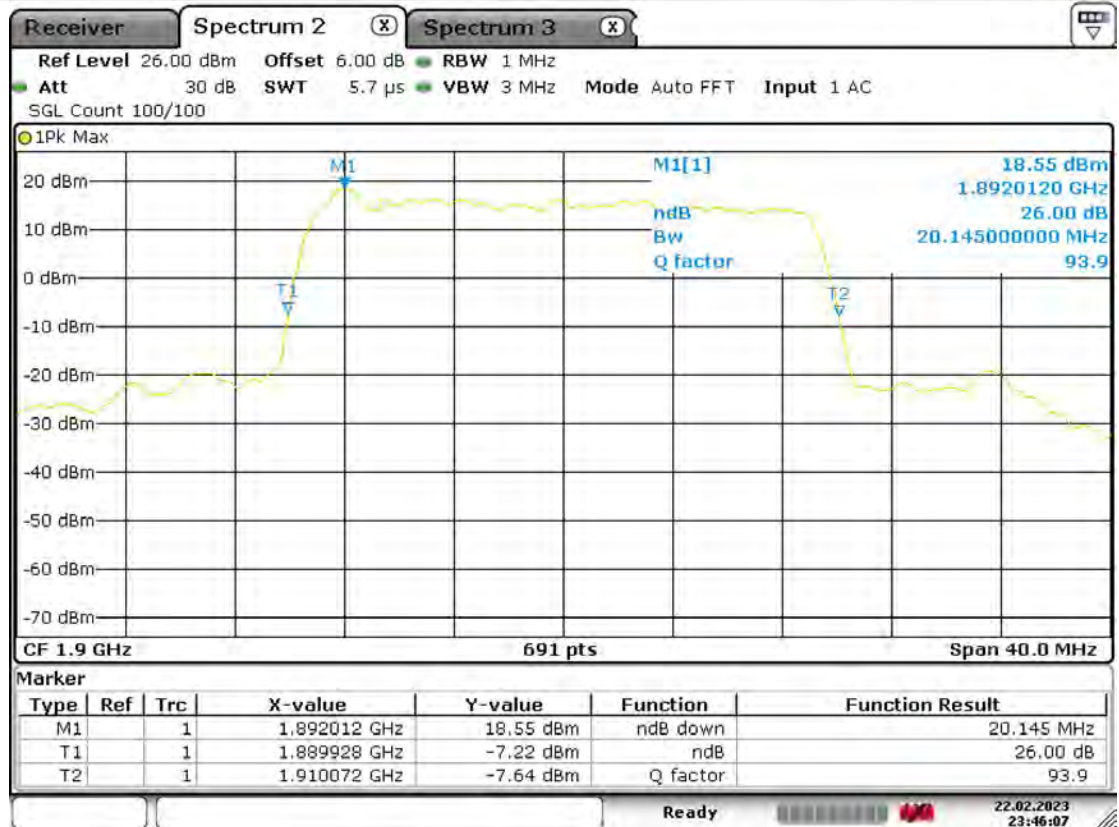

Date: 22.FEB.2023 23:46:07

**BAND EDGE****Test Result**

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dBm)	Verdict
Band2	1.4MHz	QPSK	18607	1RB#0	-29.75	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	-28.38	PASS
Band2	1.4MHz	QPSK	19193	1RB#5	-26.05	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	-23.07	PASS
Band2	1.4MHz	16QAM	18607	1RB#0	-31.54	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	-29.36	PASS
Band2	1.4MHz	16QAM	19193	1RB#5	-28.9	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	-26.22	PASS
Band2	3MHz	QPSK	18615	1RB#0	-22.90	PASS
Band2	3MHz	QPSK	18615	15RB#0	-25.22	PASS
Band2	3MHz	QPSK	19185	1RB#14	-19.24	PASS
Band2	3MHz	QPSK	19185	15RB#0	-24.42	PASS
Band2	3MHz	16QAM	18615	1RB#0	-22.07	PASS
Band2	3MHz	16QAM	18615	15RB#0	-25.64	PASS
Band2	3MHz	16QAM	19185	1RB#14	-19.72	PASS
Band2	3MHz	16QAM	19185	15RB#0	-23.86	PASS
Band2	5MHz	QPSK	18625	1RB#0	-28.47	PASS
Band2	5MHz	QPSK	18625	25RB#0	-27.46	PASS
Band2	5MHz	QPSK	19175	1RB#24	-27.53	PASS
Band2	5MHz	QPSK	19175	25RB#0	-25.85	PASS
Band2	5MHz	16QAM	18625	1RB#0	-29.48	PASS
Band2	5MHz	16QAM	18625	25RB#0	-27.52	PASS
Band2	5MHz	16QAM	19175	1RB#24	-26.67	PASS
Band2	5MHz	16QAM	19175	25RB#0	-24.59	PASS
Band2	10MHz	QPSK	18650	1RB#0	-37.52	PASS
Band2	10MHz	QPSK	18650	50RB#0	-30.00	PASS
Band2	10MHz	QPSK	19150	1RB#49	-34.07	PASS
Band2	10MHz	QPSK	19150	50RB#0	-27.12	PASS
Band2	10MHz	16QAM	18650	1RB#0	-38.36	PASS
Band2	10MHz	16QAM	18650	50RB#0	-29.95	PASS
Band2	10MHz	16QAM	19150	1RB#49	-36.99	PASS
Band2	10MHz	16QAM	19150	50RB#0	-25.71	PASS
Band2	15MHz	QPSK	18675	1RB#0	-39.39	PASS
Band2	15MHz	QPSK	18675	75RB#0	-31.45	PASS
Band2	15MHz	QPSK	19125	1RB#74	-38.20	PASS
Band2	15MHz	QPSK	19125	75RB#0	-29.13	PASS
Band2	15MHz	16QAM	18675	1RB#0	-40.37	PASS
Band2	15MHz	16QAM	18675	75RB#0	-32.11	PASS
Band2	15MHz	16QAM	19125	1RB#74	-38.98	PASS
Band2	15MHz	16QAM	19125	75RB#0	-28.29	PASS
Band2	20MHz	QPSK	18700	1RB#0	-42.80	PASS
Band2	20MHz	QPSK	18700	100RB#0	-32.36	PASS
Band2	20MHz	QPSK	19100	1RB#99	-42.52	PASS
Band2	20MHz	QPSK	19100	100RB#0	-30.73	PASS



Test Report No.: PSU-QSU2308280314RF02

Band2	20MHz	16QAM	18700	1RB#0	-43.86	PASS
Band2	20MHz	16QAM	18700	100RB#0	-32.73	PASS
Band2	20MHz	16QAM	19100	1RB#99	-43.19	PASS
Band2	20MHz	16QAM	19100	100RB#0	-30.34	PASS
Band2	1.4MHz	64QAM	18607	1RB#0	-32.76	PASS
Band2	1.4MHz	64QAM	18607	6RB#0	-28.25	PASS
Band2	1.4MHz	64QAM	19193	1RB#5	-29.92	PASS
Band2	1.4MHz	64QAM	19193	6RB#0	-25.62	PASS
Band2	3MHz	64QAM	18615	1RB#0	-23.08	PASS
Band2	3MHz	64QAM	18615	15RB#0	-26.33	PASS
Band2	3MHz	64QAM	19185	1RB#14	-22.60	PASS
Band2	3MHz	64QAM	19185	15RB#0	-23.37	PASS
Band2	5MHz	64QAM	18625	1RB#0	-30.36	PASS
Band2	5MHz	64QAM	18625	25RB#0	-27.98	PASS
Band2	5MHz	64QAM	19175	1RB#24	-27.28	PASS
Band2	5MHz	64QAM	19175	25RB#0	-23.70	PASS
Band2	10MHz	64QAM	18650	1RB#0	-38.24	PASS
Band2	10MHz	64QAM	18650	50RB#0	-30.62	PASS
Band2	10MHz	64QAM	19150	1RB#49	-36.44	PASS
Band2	10MHz	64QAM	19150	50RB#0	-25.38	PASS
Band2	15MHz	64QAM	18675	1RB#0	-40.14	PASS
Band2	15MHz	64QAM	18675	75RB#0	-32.87	PASS
Band2	15MHz	64QAM	19125	1RB#74	-40.12	PASS
Band2	15MHz	64QAM	19125	75RB#0	-27.92	PASS
Band2	20MHz	64QAM	18700	1RB#0	-42.03	PASS
Band2	20MHz	64QAM	18700	100RB#0	-33.82	PASS
Band2	20MHz	64QAM	19100	1RB#99	-43.25	PASS
Band2	20MHz	64QAM	19100	100RB#0	-29.62	PASS

Test Graphs

Band2-1.4MHz-QPSK-18607-1RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02





BUREAU
VERITAS


Test Report No.: PSU-QSU2308280314RF02





BUREAU
VERITAS


Test Report No.: PSU-QSU2308280314RF02

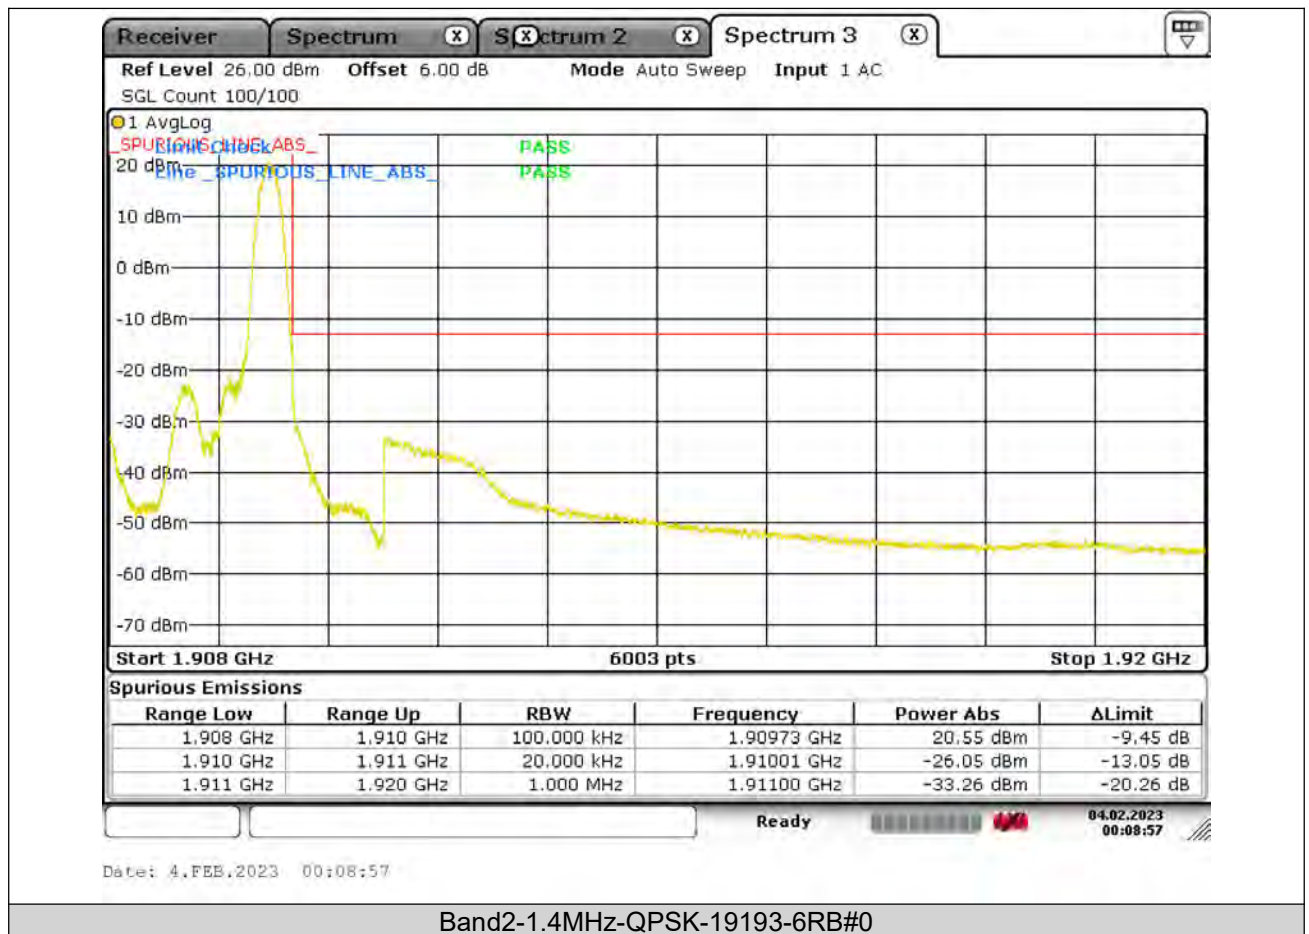



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

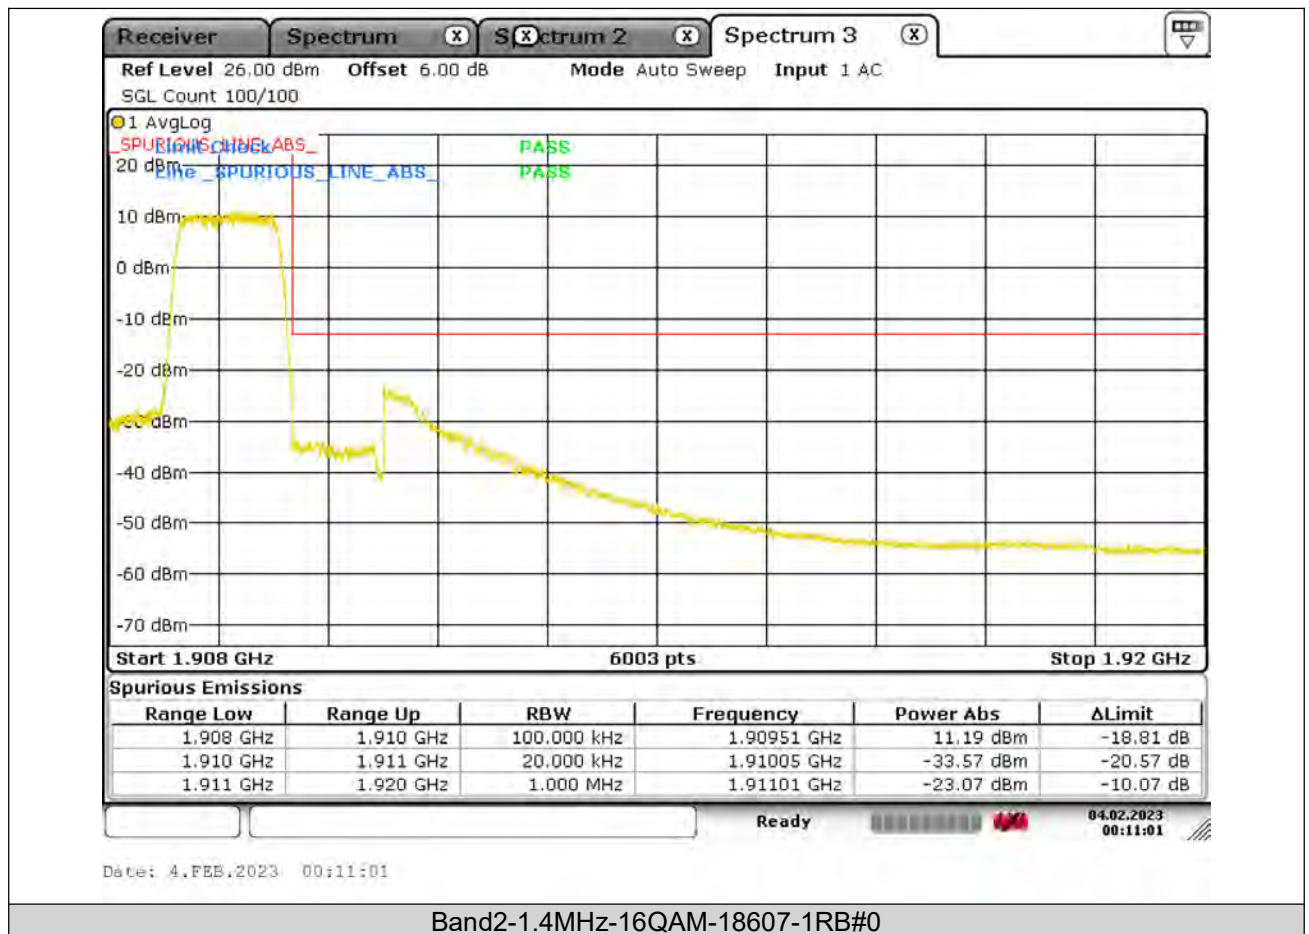



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02





BUREAU
VERITAS


Test Report No.: PSU-QSU2308280314RF02





BUREAU
VERITAS


Test Report No.: PSU-QSU2308280314RF02

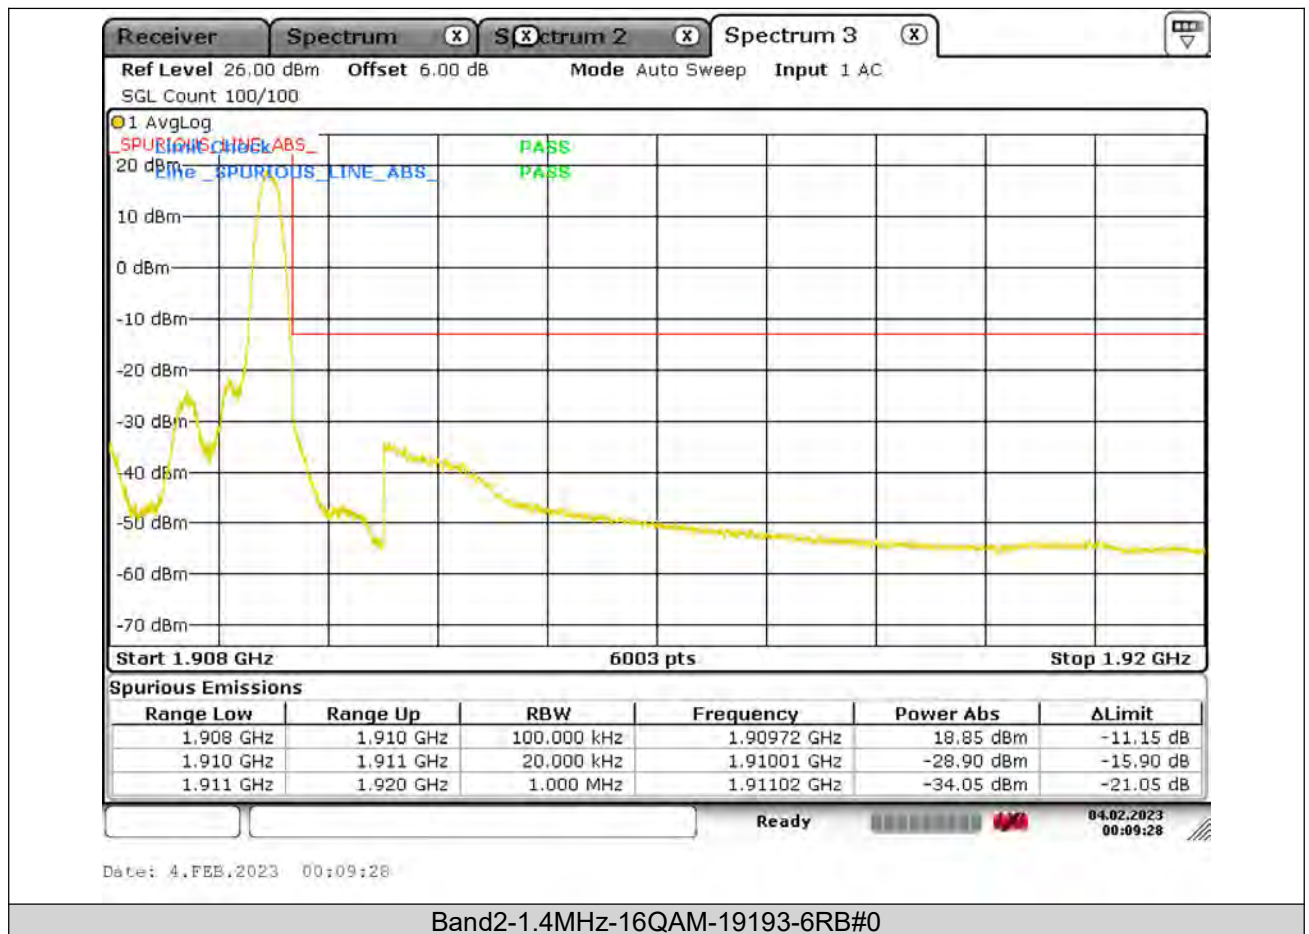



BUREAU
VERITAS


Test Report No.: PSU-QSU2308280314RF02

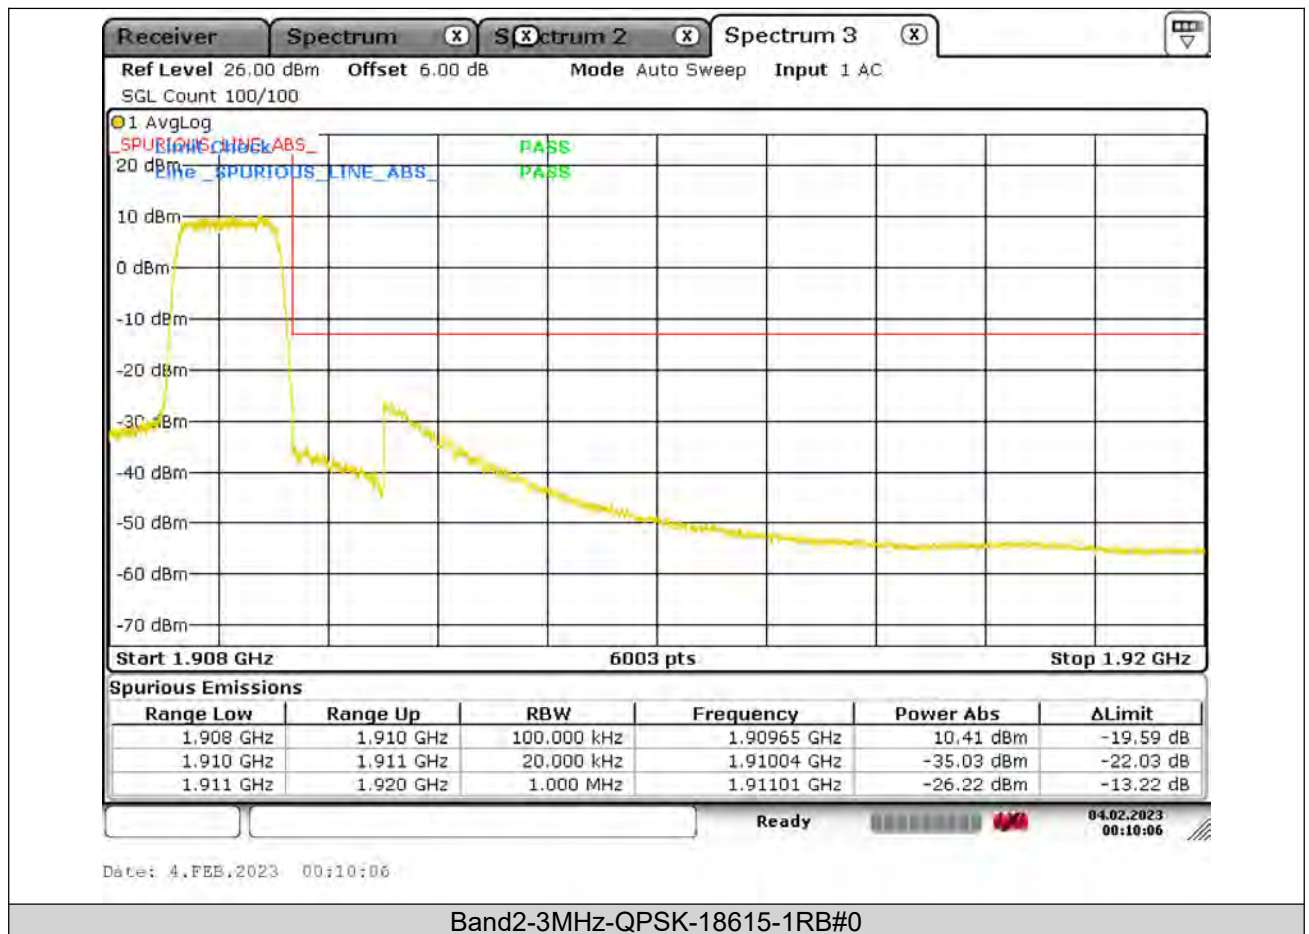



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

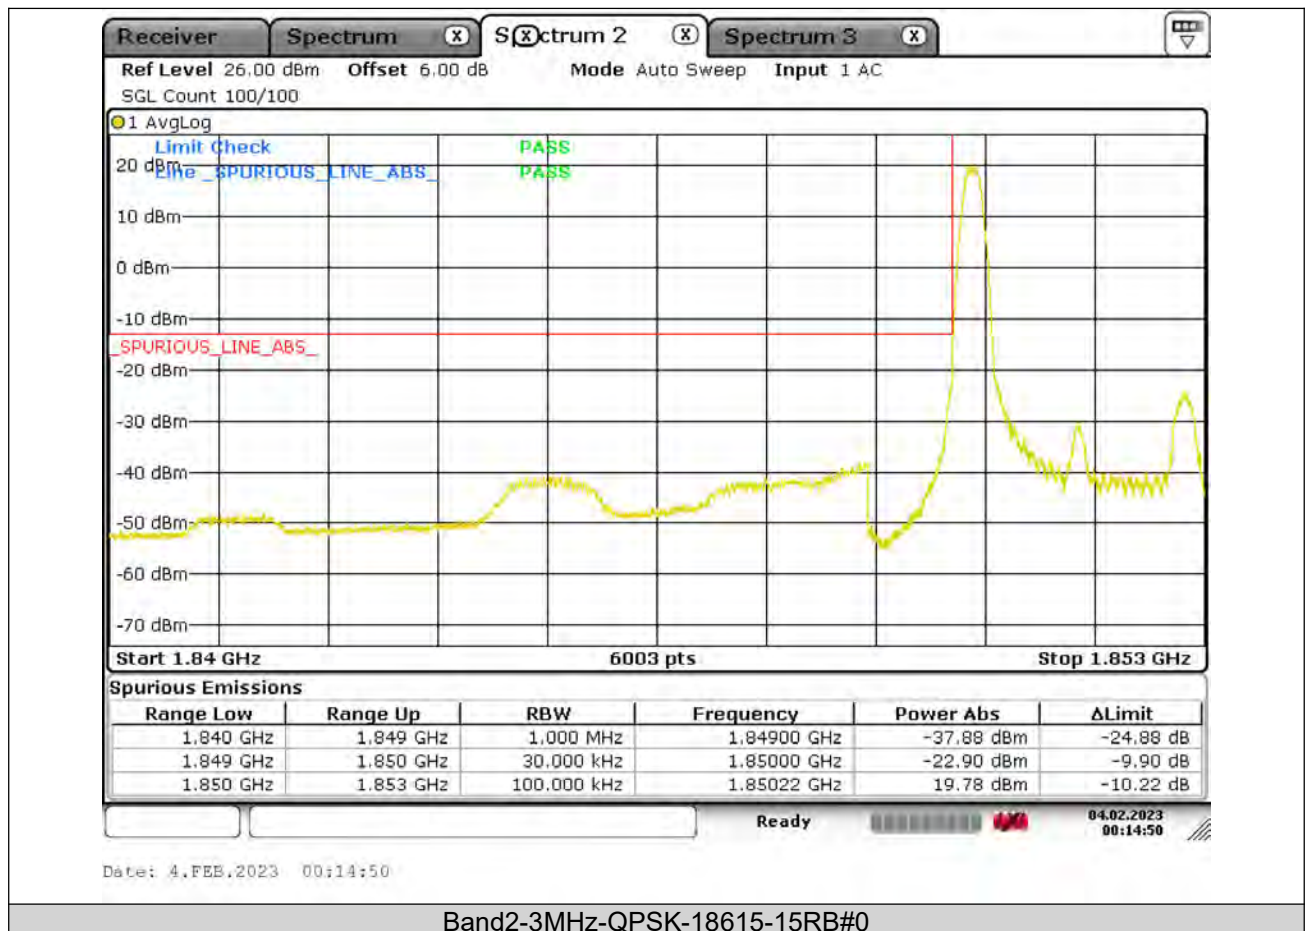



BUREAU
VERITAS


Test Report No.: PSU-QSU2308280314RF02





BUREAU
VERITAS


Test Report No.: PSU-QSU2308280314RF02

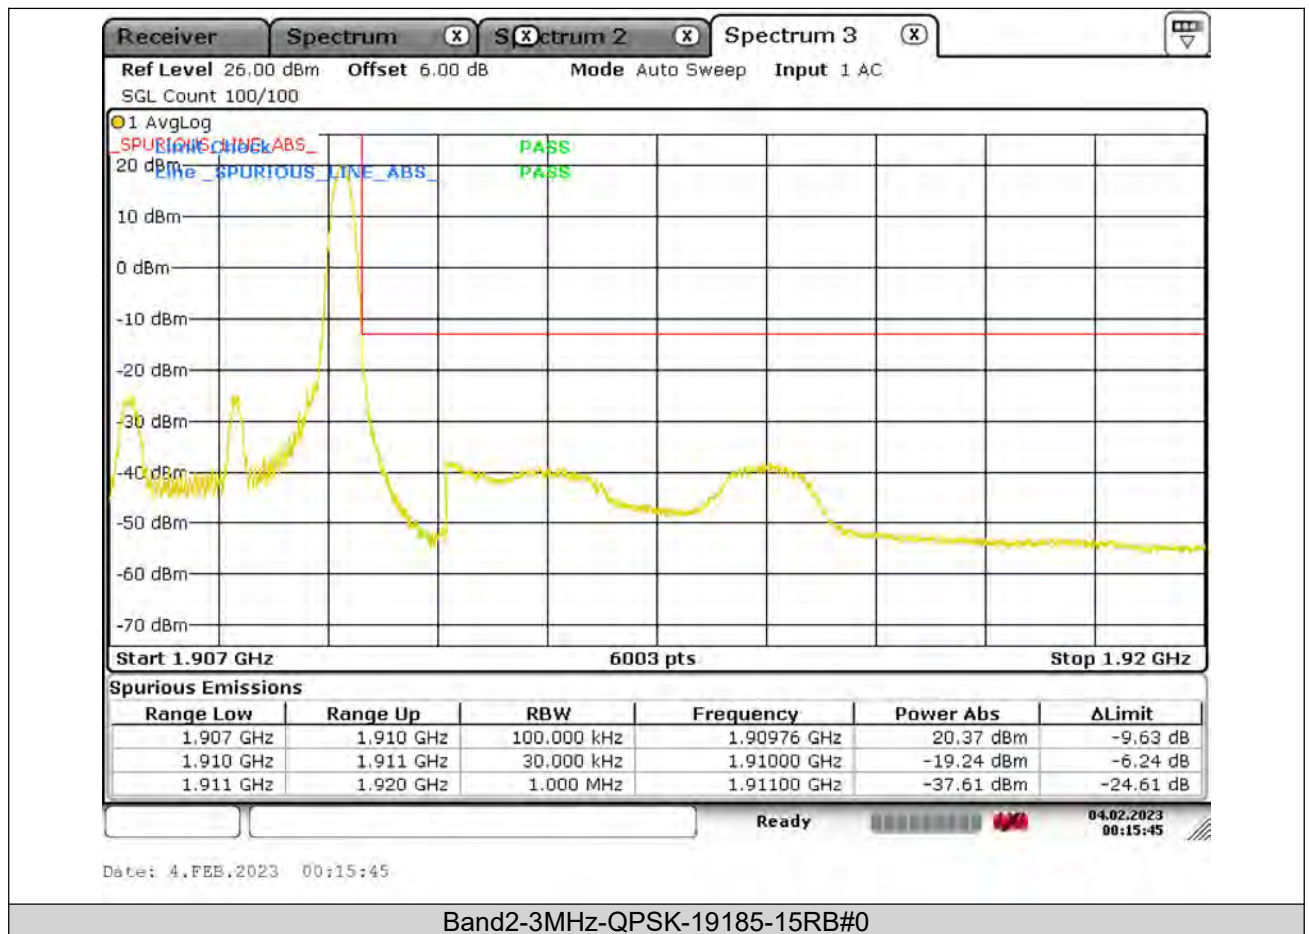



BUREAU
VERITAS


Test Report No.: PSU-QSU2308280314RF02

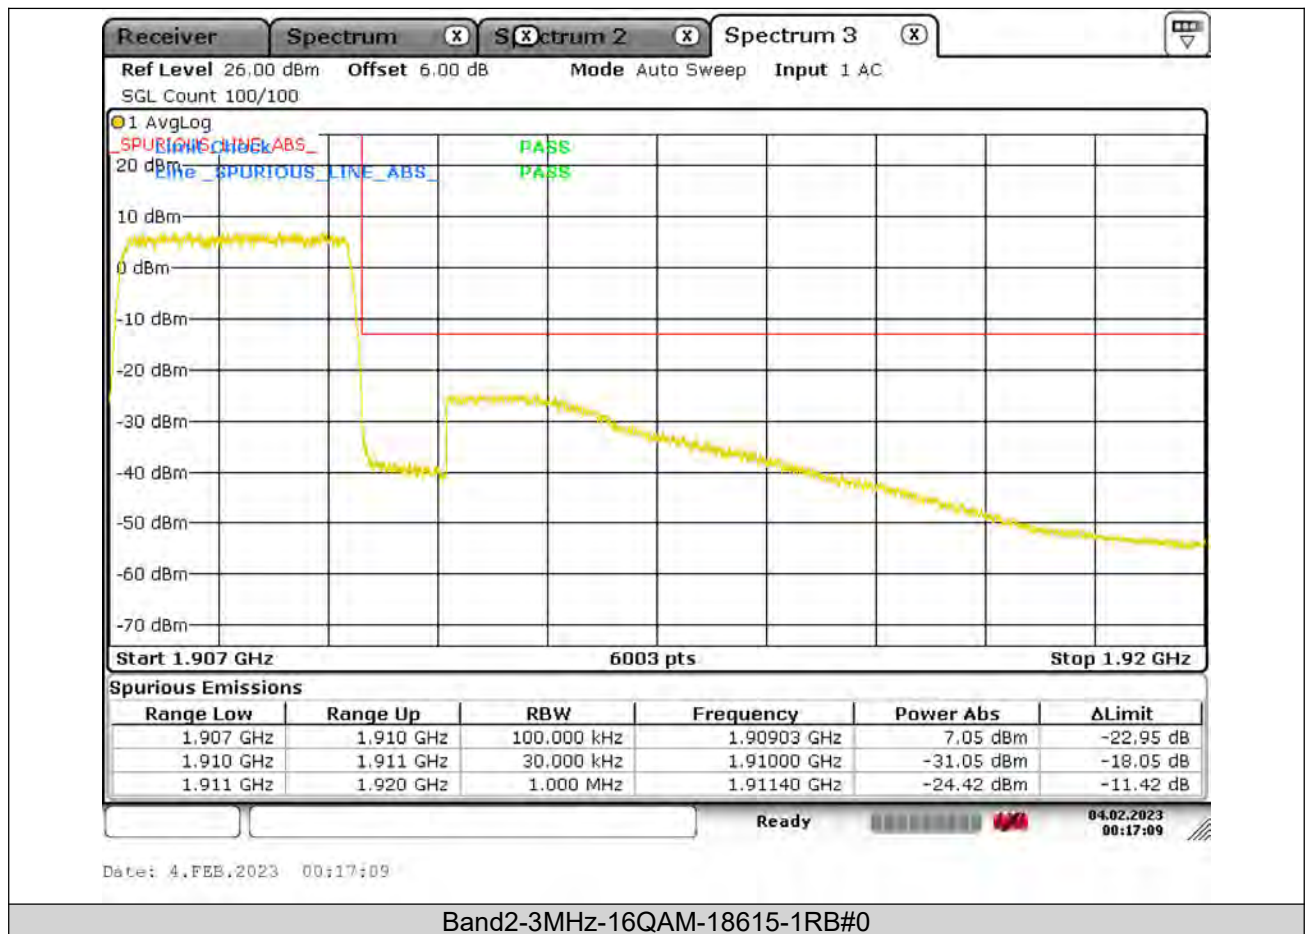



BUREAU
VERITAS


Test Report No.: PSU-QSU2308280314RF02

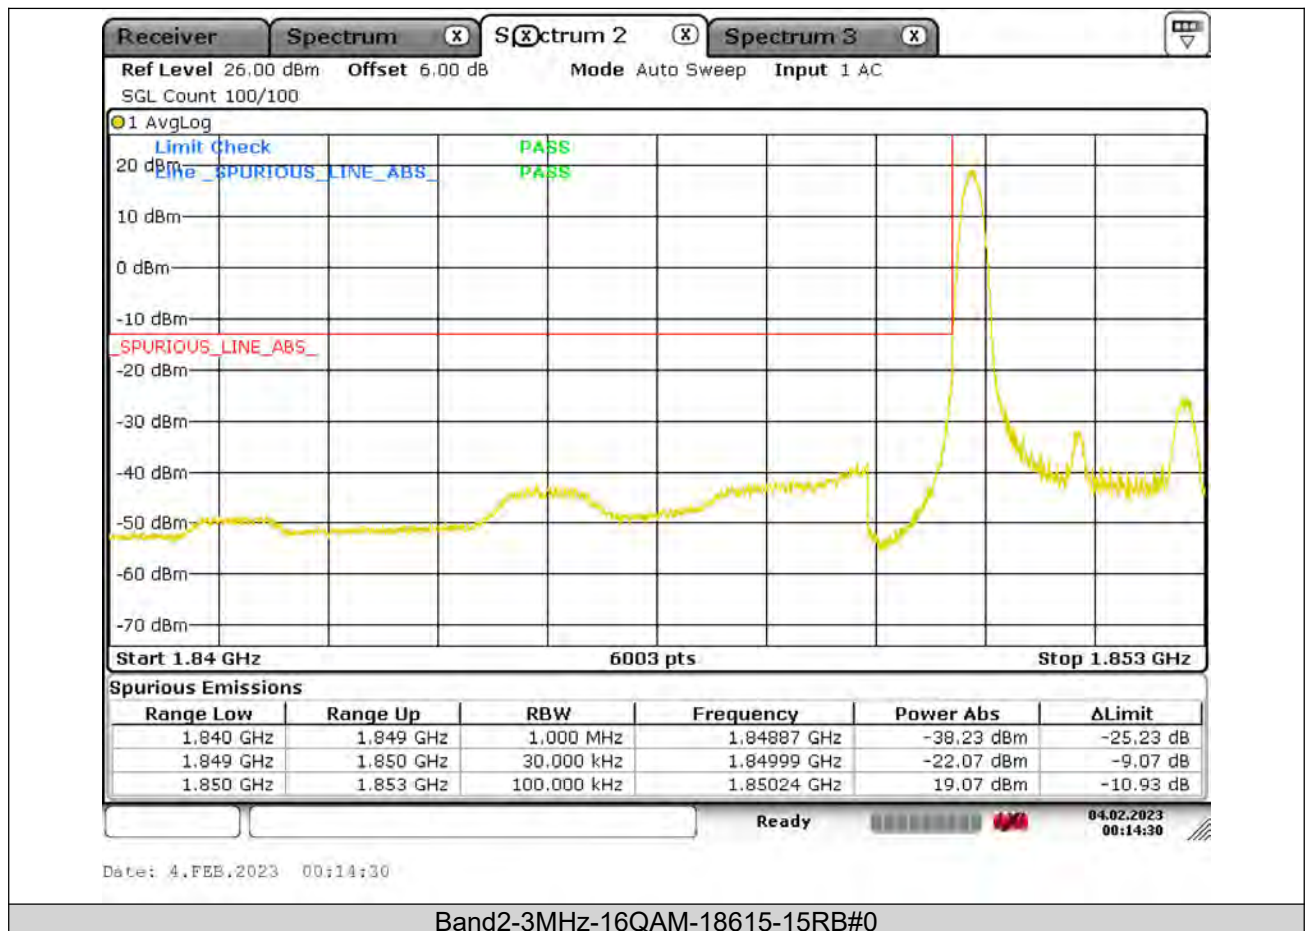



BUREAU
VERITAS


Test Report No.: PSU-QSU2308280314RF02

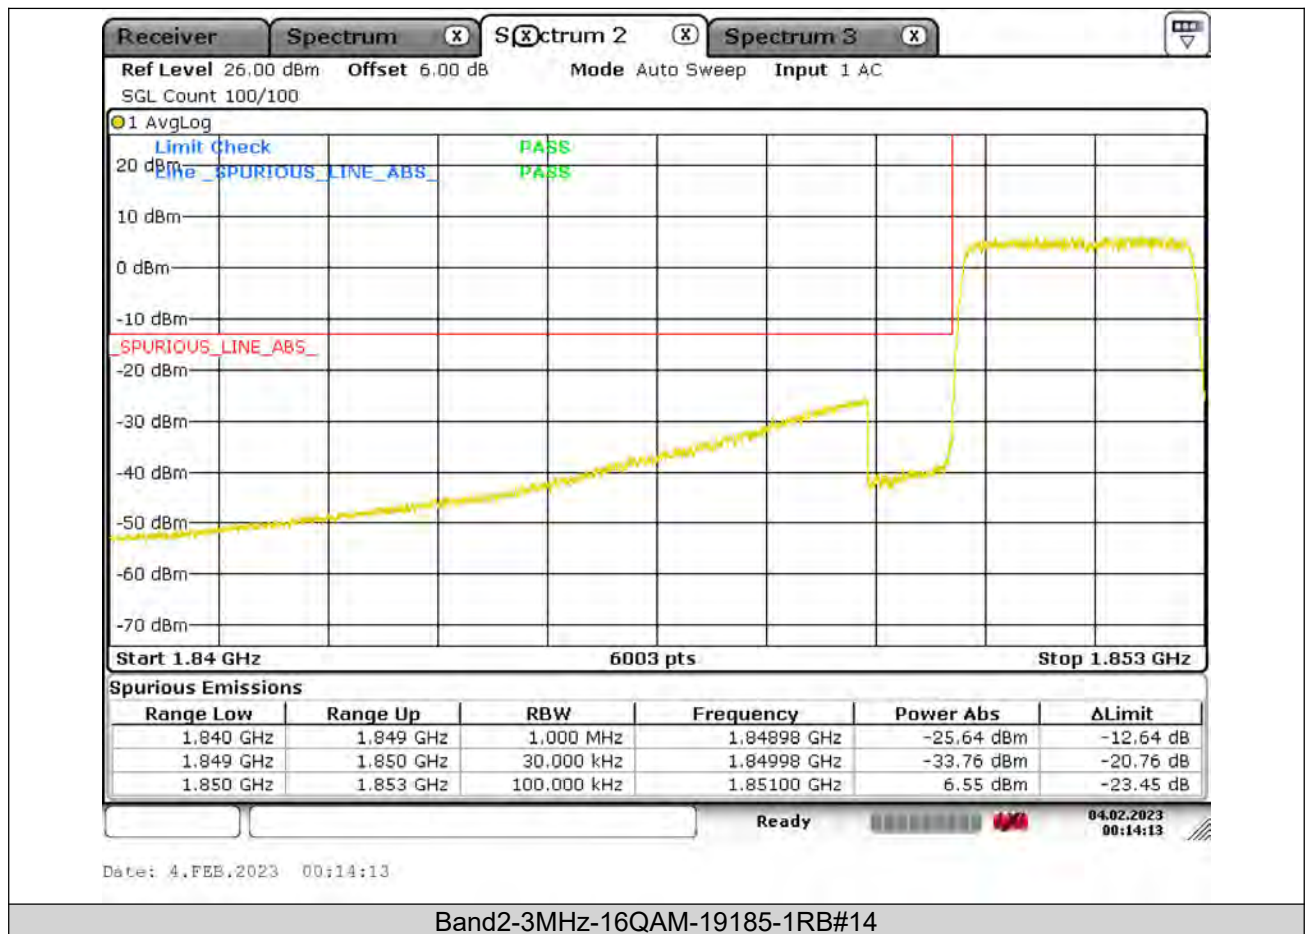



BUREAU
VERITAS


Test Report No.: PSU-QSU2308280314RF02

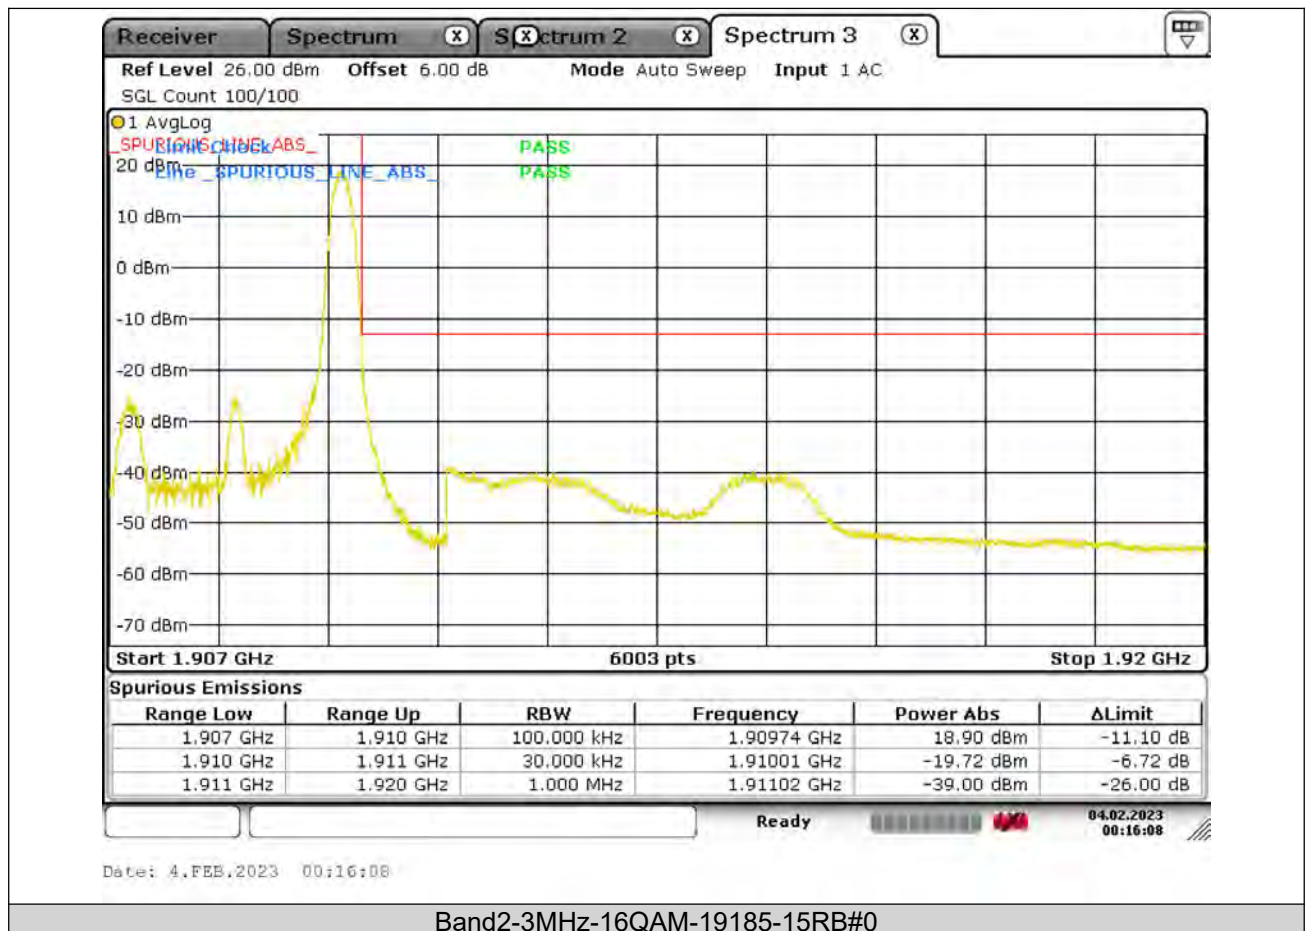



BUREAU
VERITAS


Test Report No.: PSU-QSU2308280314RF02

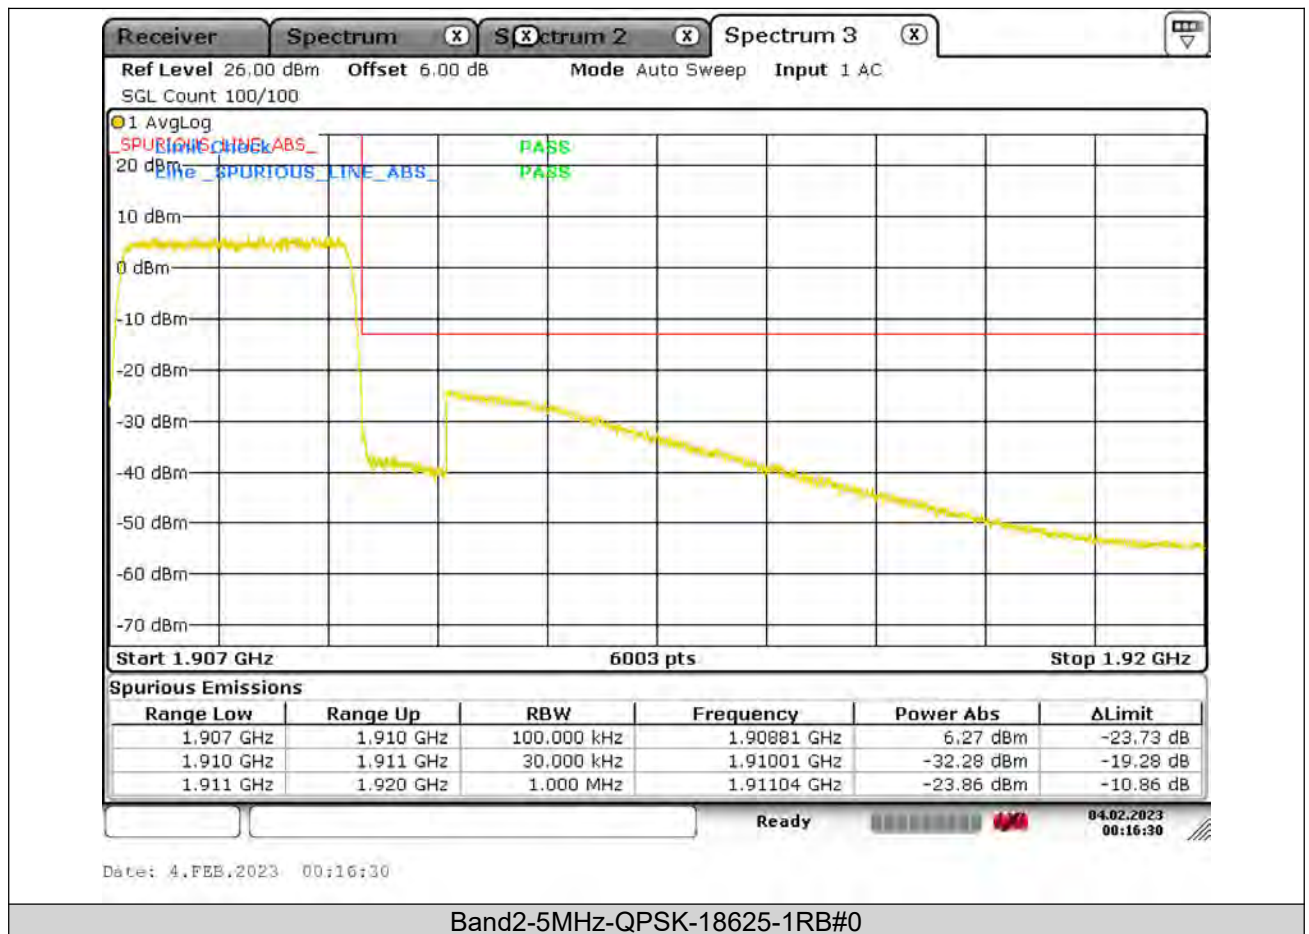



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

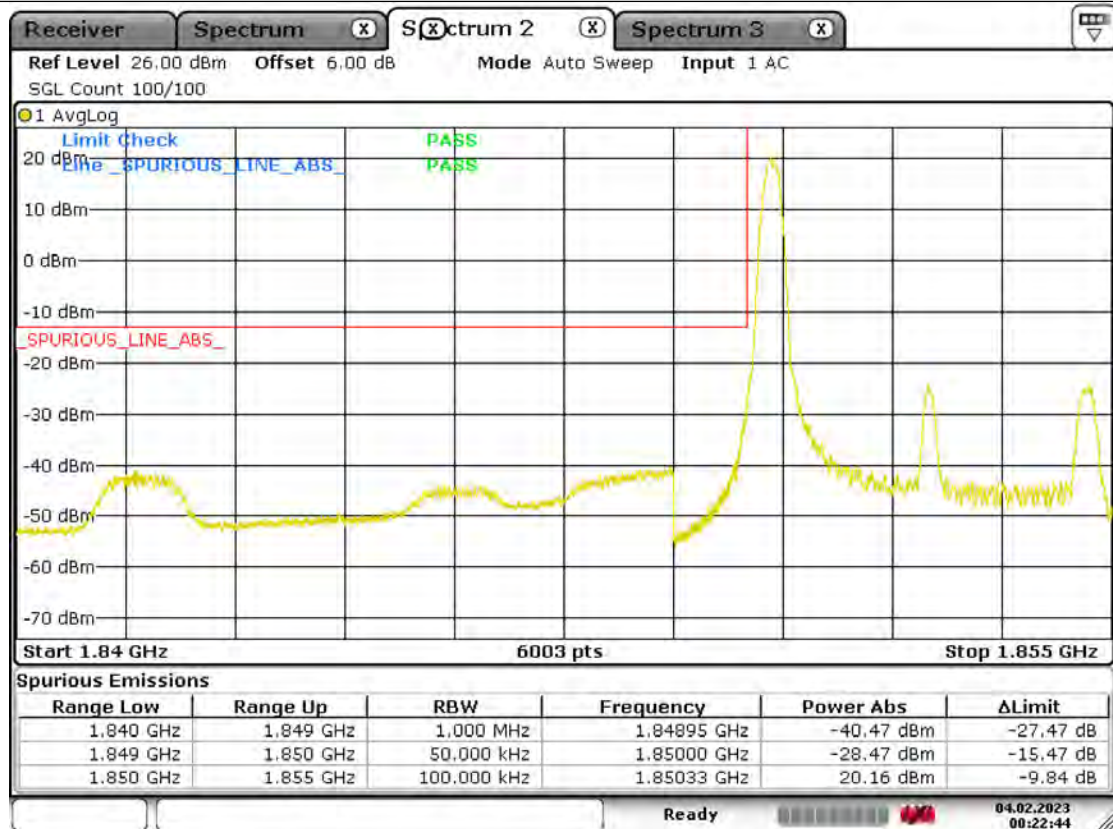


Date: 4.FEB.2023 00:22:44

Band2-5MHz-QPSK-18625-25RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

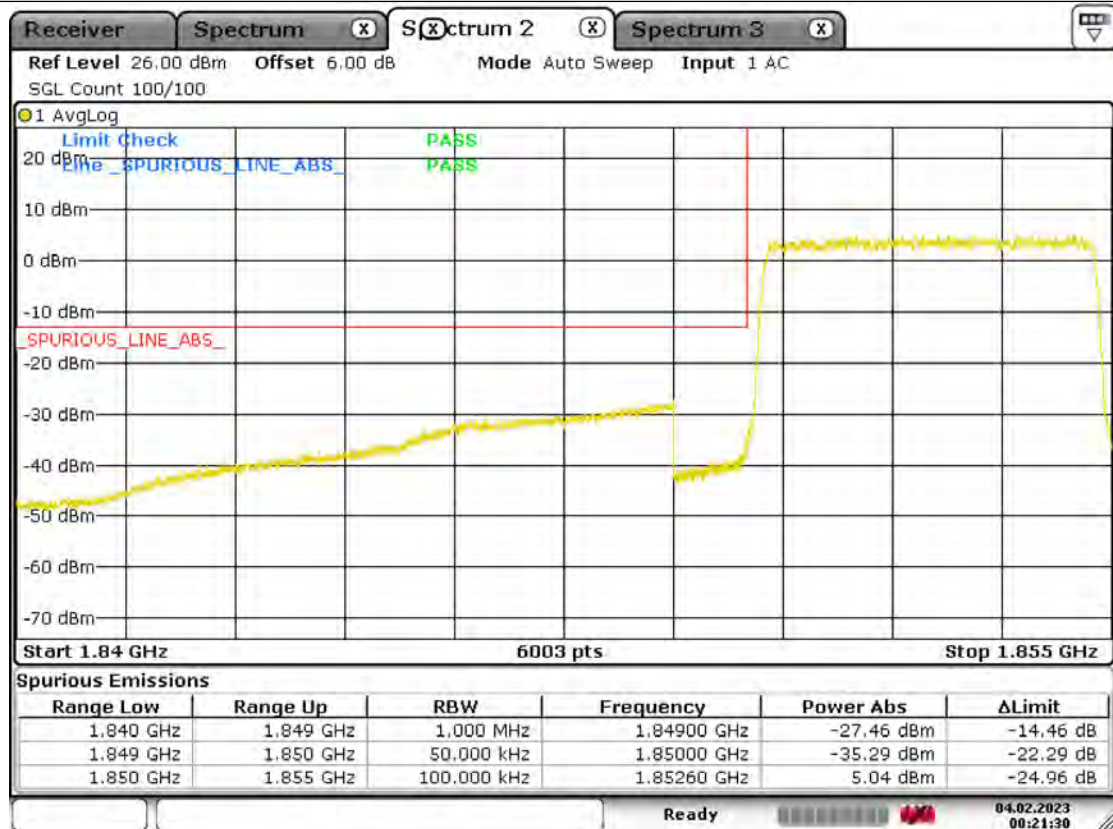


Date: 4.FEB.2023 00:21:30

Band2-5MHz-QPSK-19175-1RB#24



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

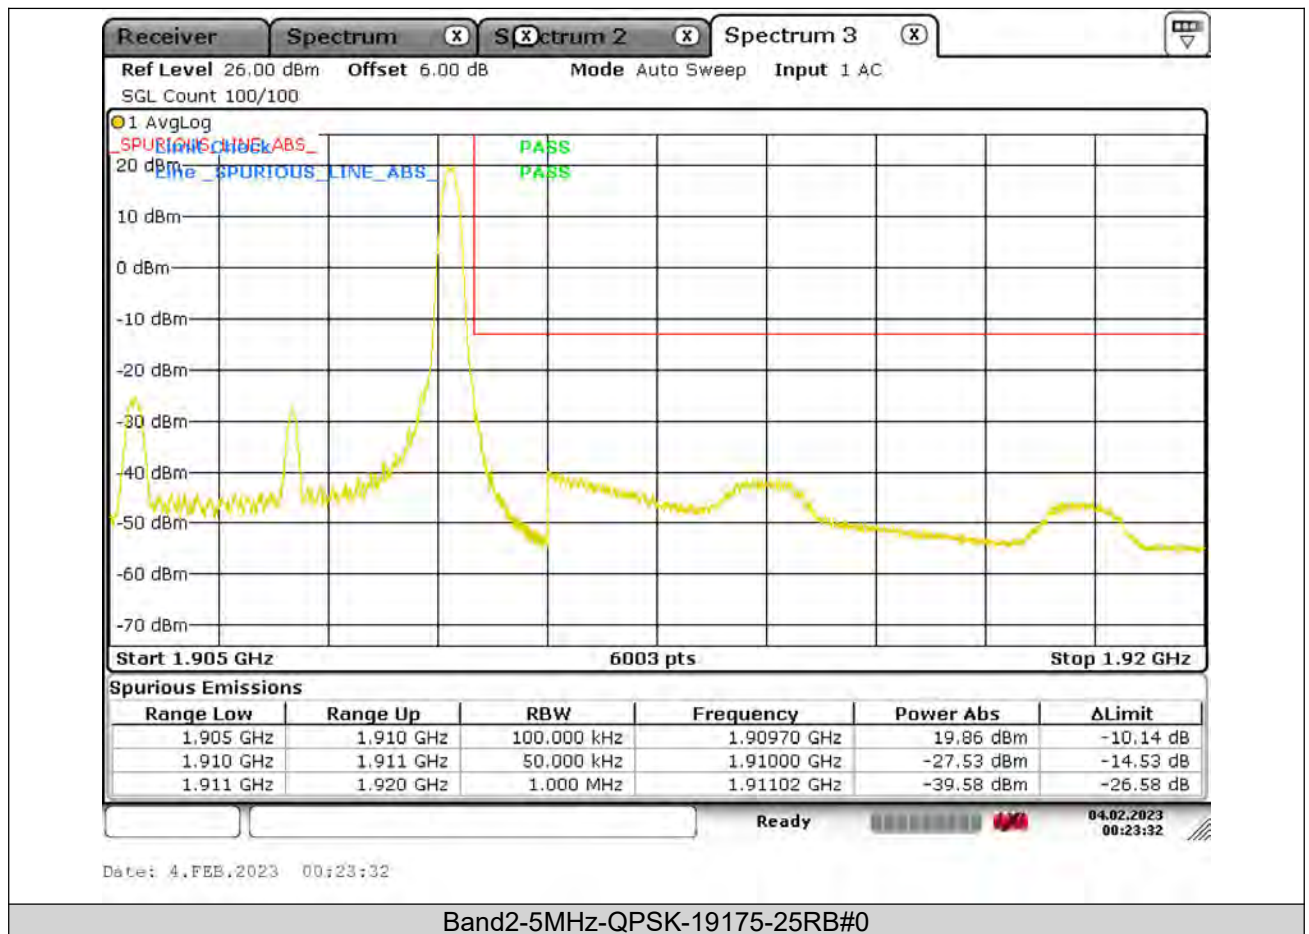



BUREAU
VERITAS


Test Report No.: PSU-QSU2308280314RF02





BUREAU
VERITAS


Test Report No.: PSU-QSU2308280314RF02

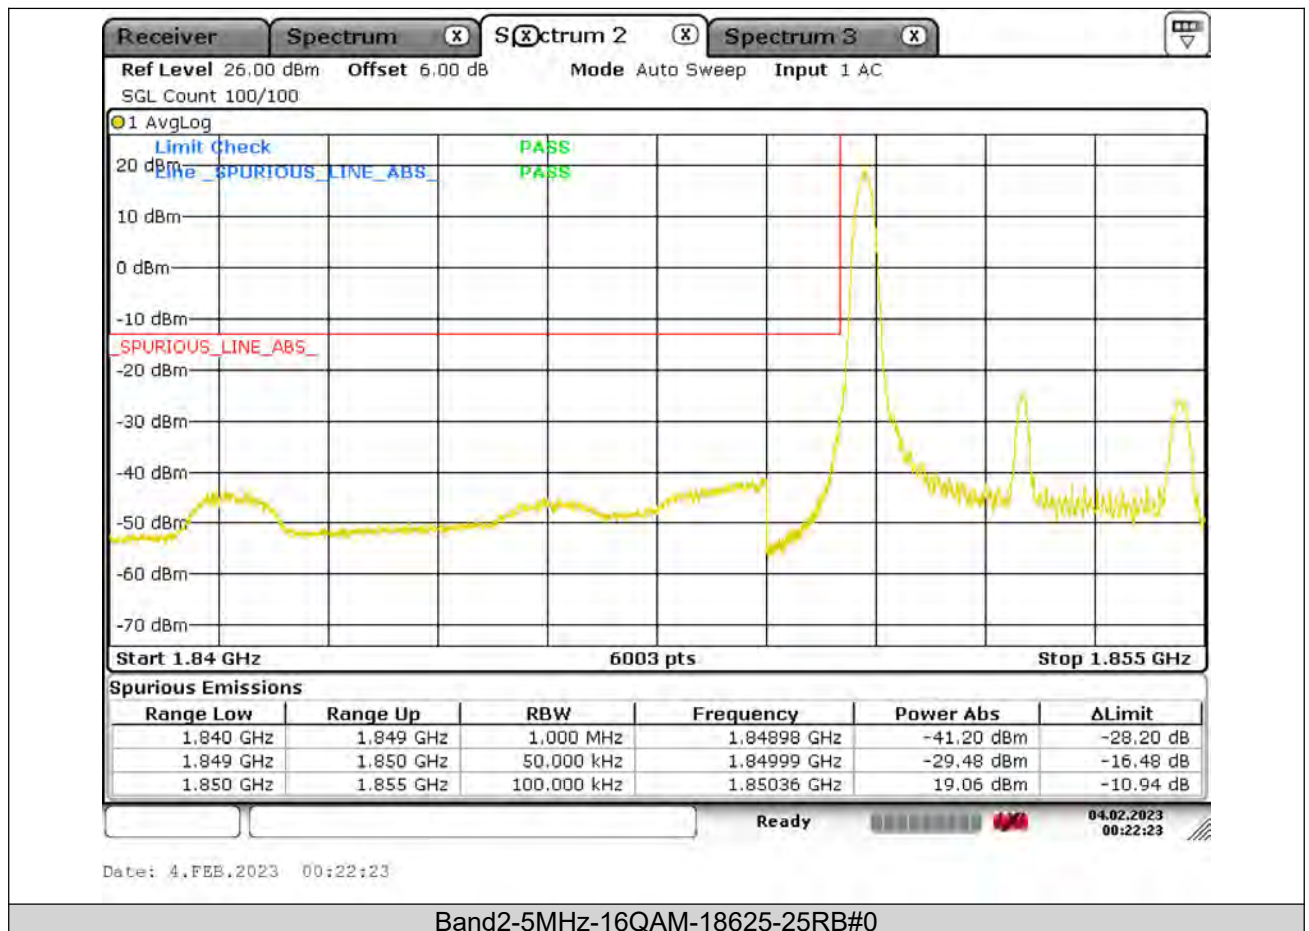



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

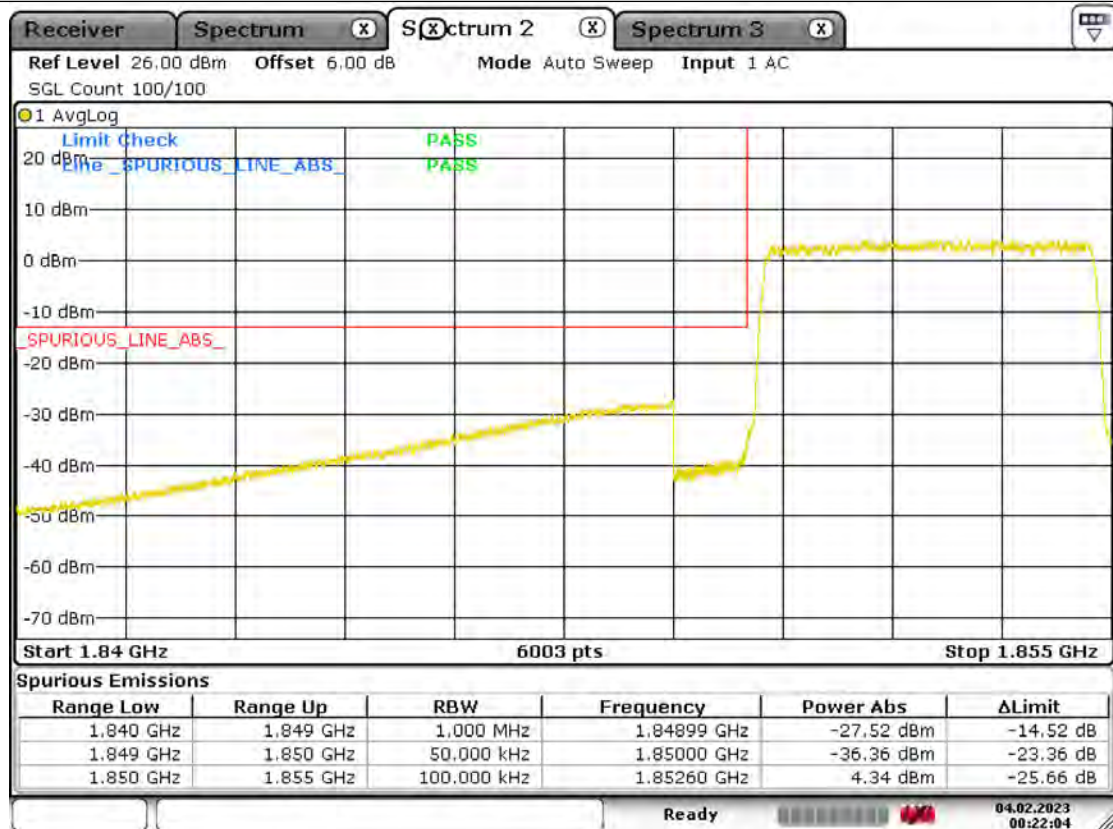


Date: 4.FEB.2023 00:22:04

Band2-5MHz-16QAM-19175-1RB#24



BUREAU
VERITAS


Test Report No.: PSU-QSU2308280314RF02

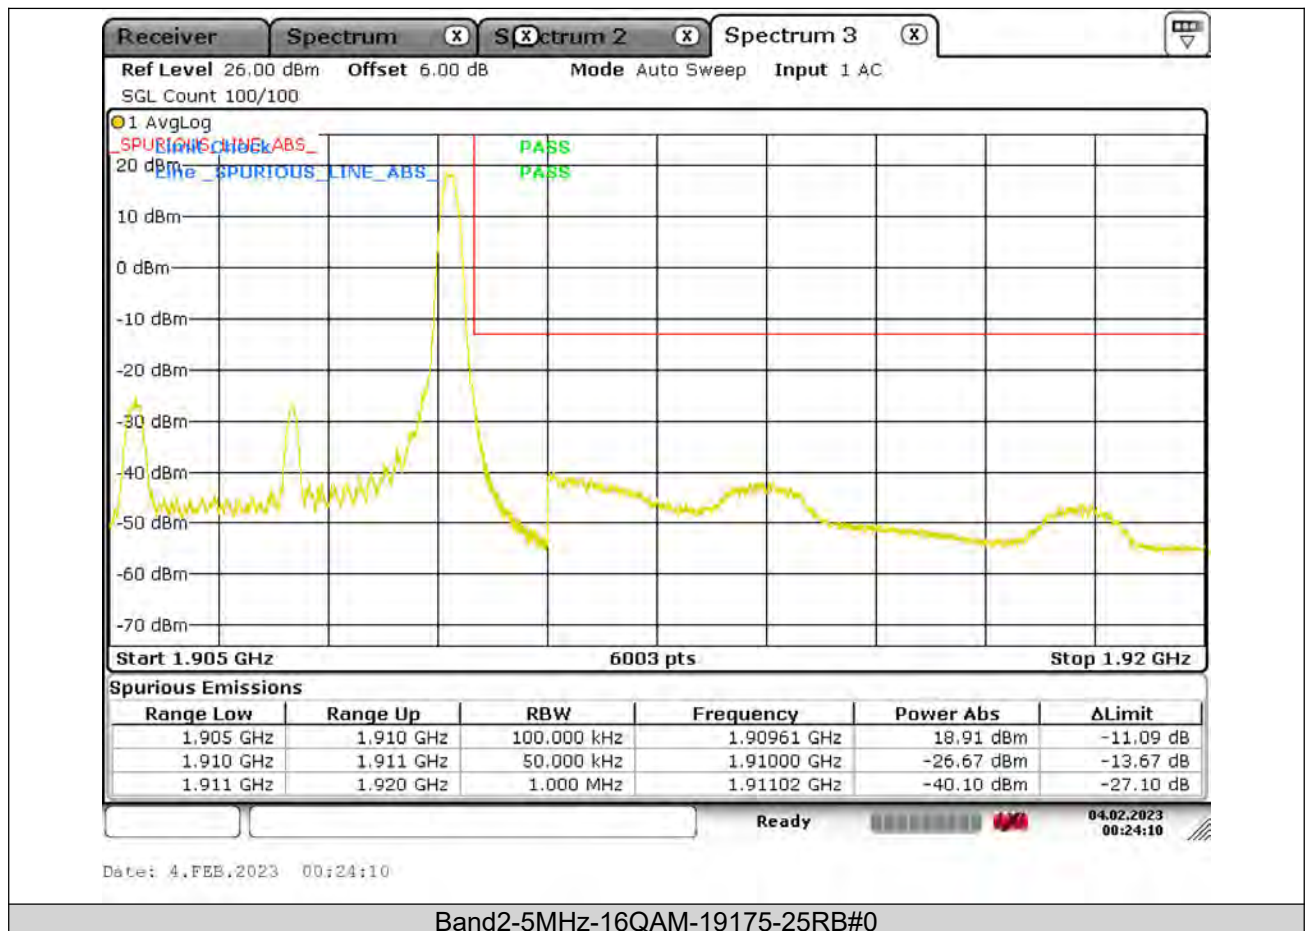



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

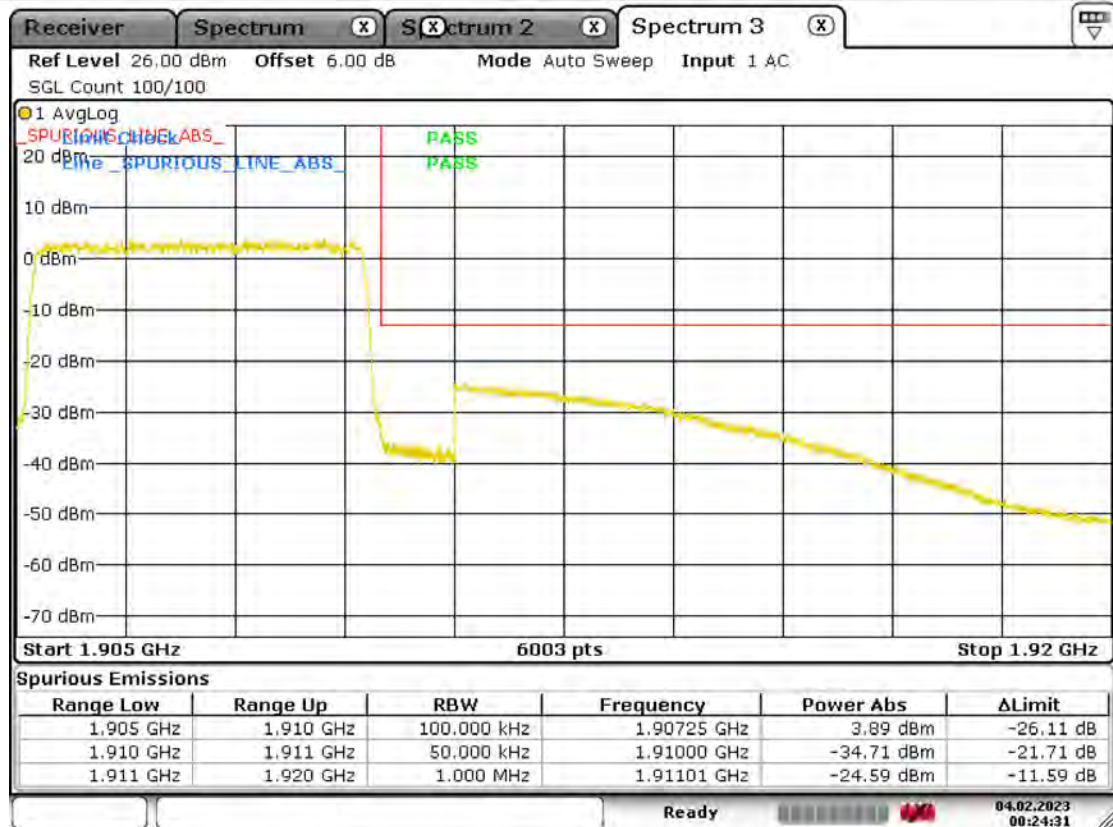


Date: 4.FEB.2023 00:24:31

Band2-10MHz-QPSK-18650-1RB#0



BUREAU
VERITAS


Test Report No.: PSU-QSU2308280314RF02

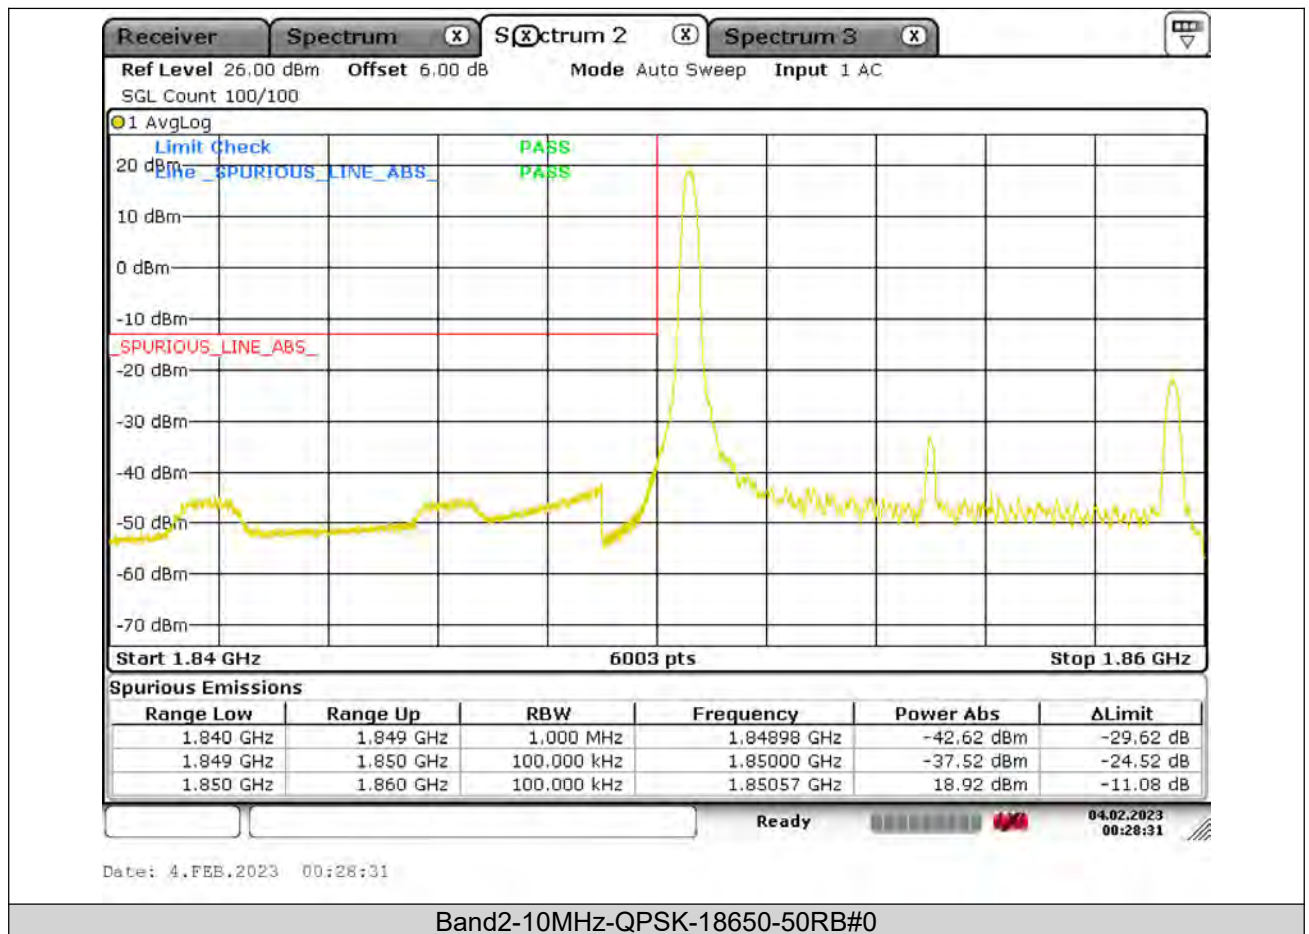



BUREAU
VERITAS


Test Report No.: PSU-QSU2308280314RF02

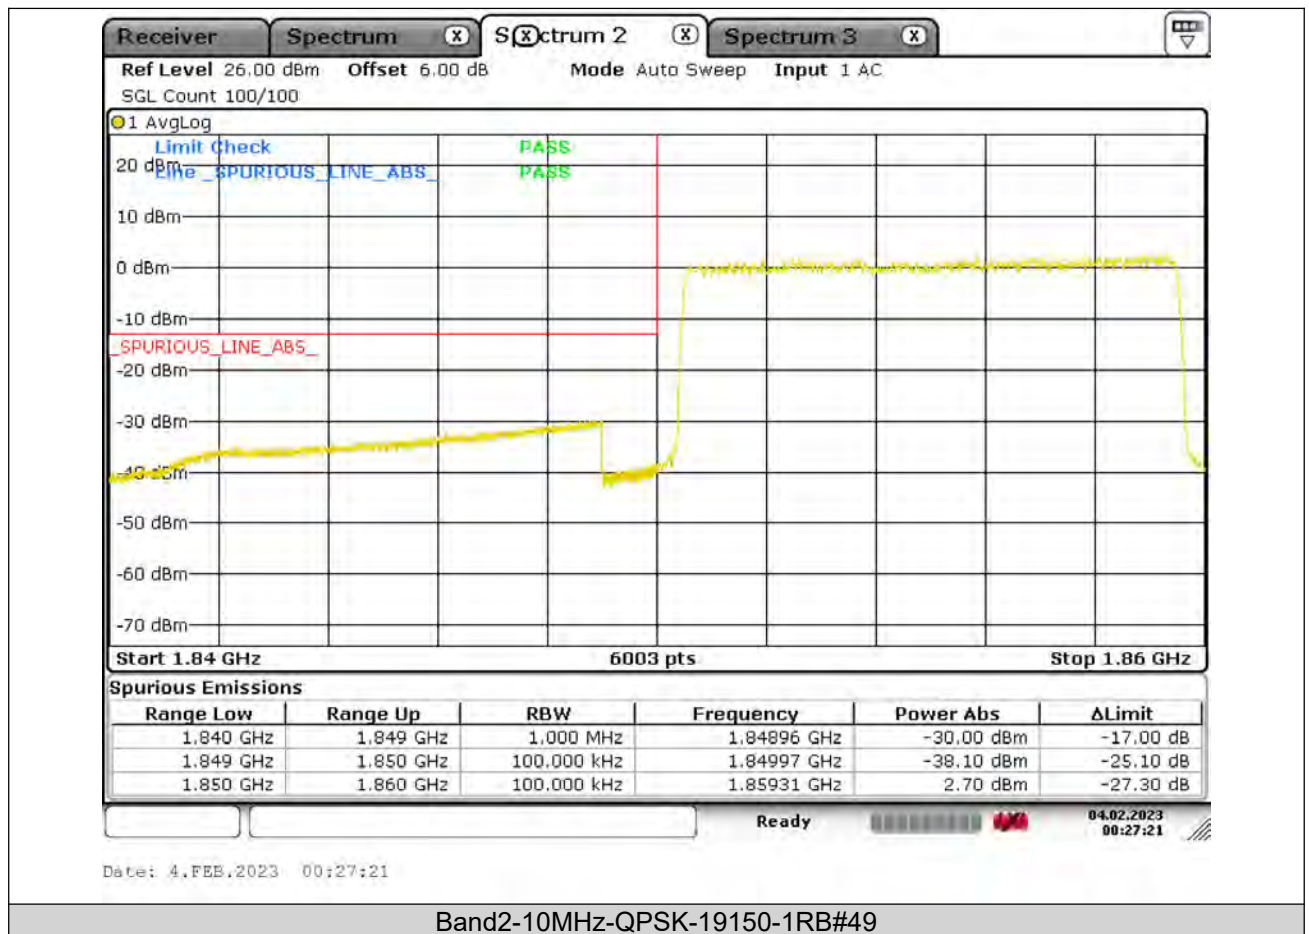



BUREAU
VERITAS


Test Report No.: PSU-QSU2308280314RF02

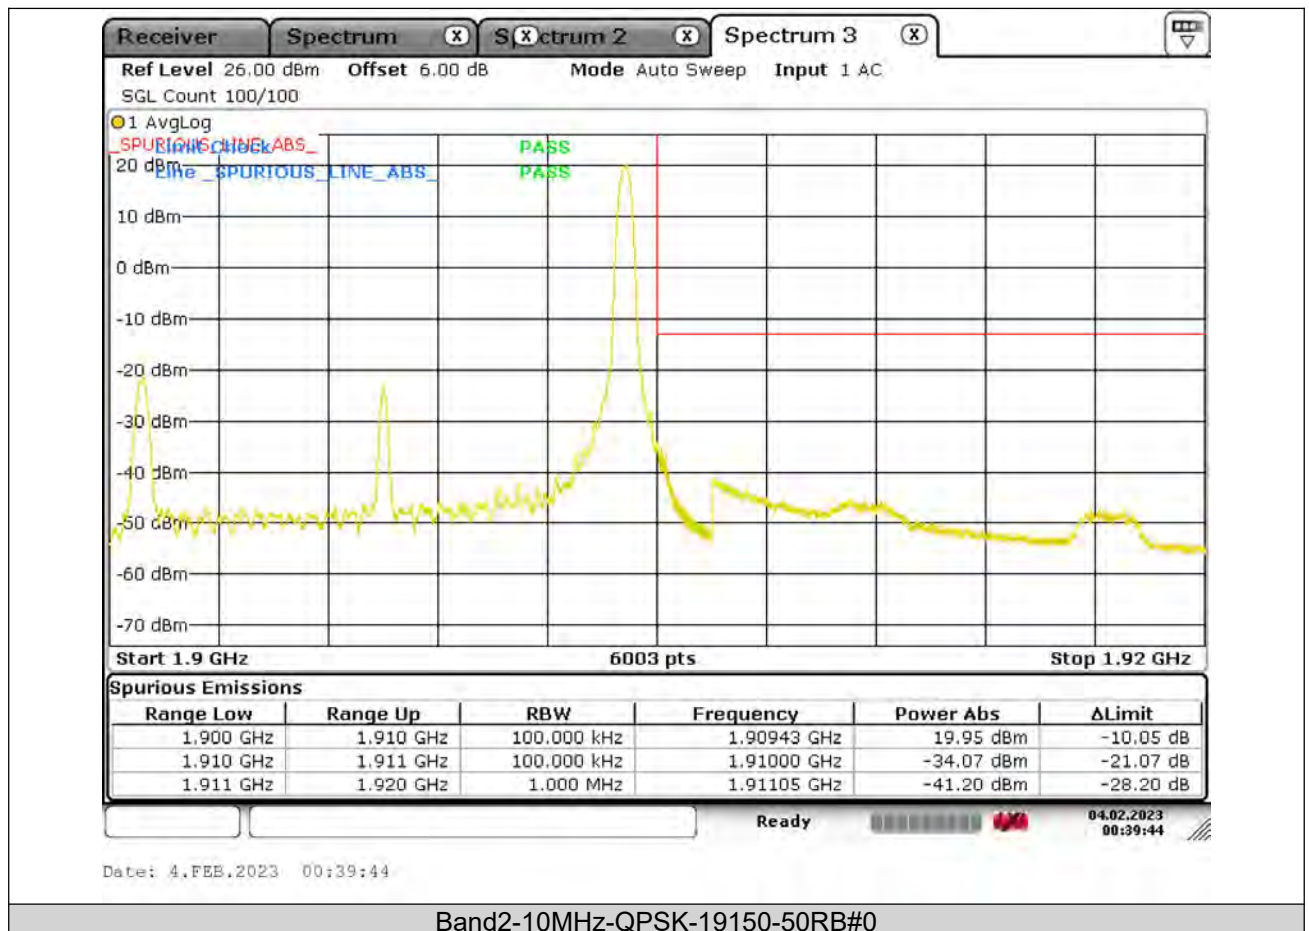



BUREAU
VERITAS


Test Report No.: PSU-QSU2308280314RF02

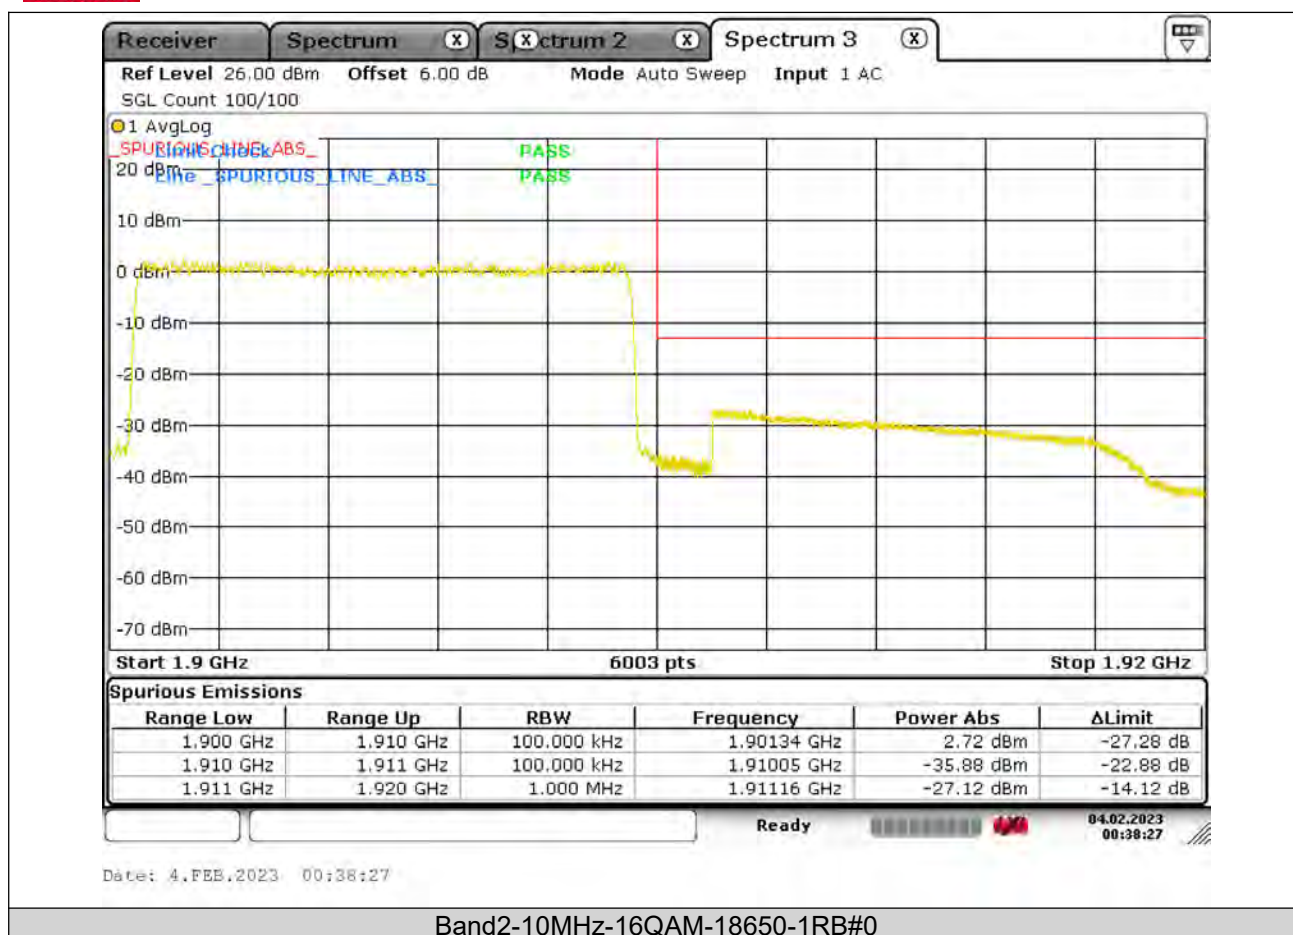



BUREAU
VERITAS


Test Report No.: PSU-QSU2308280314RF02

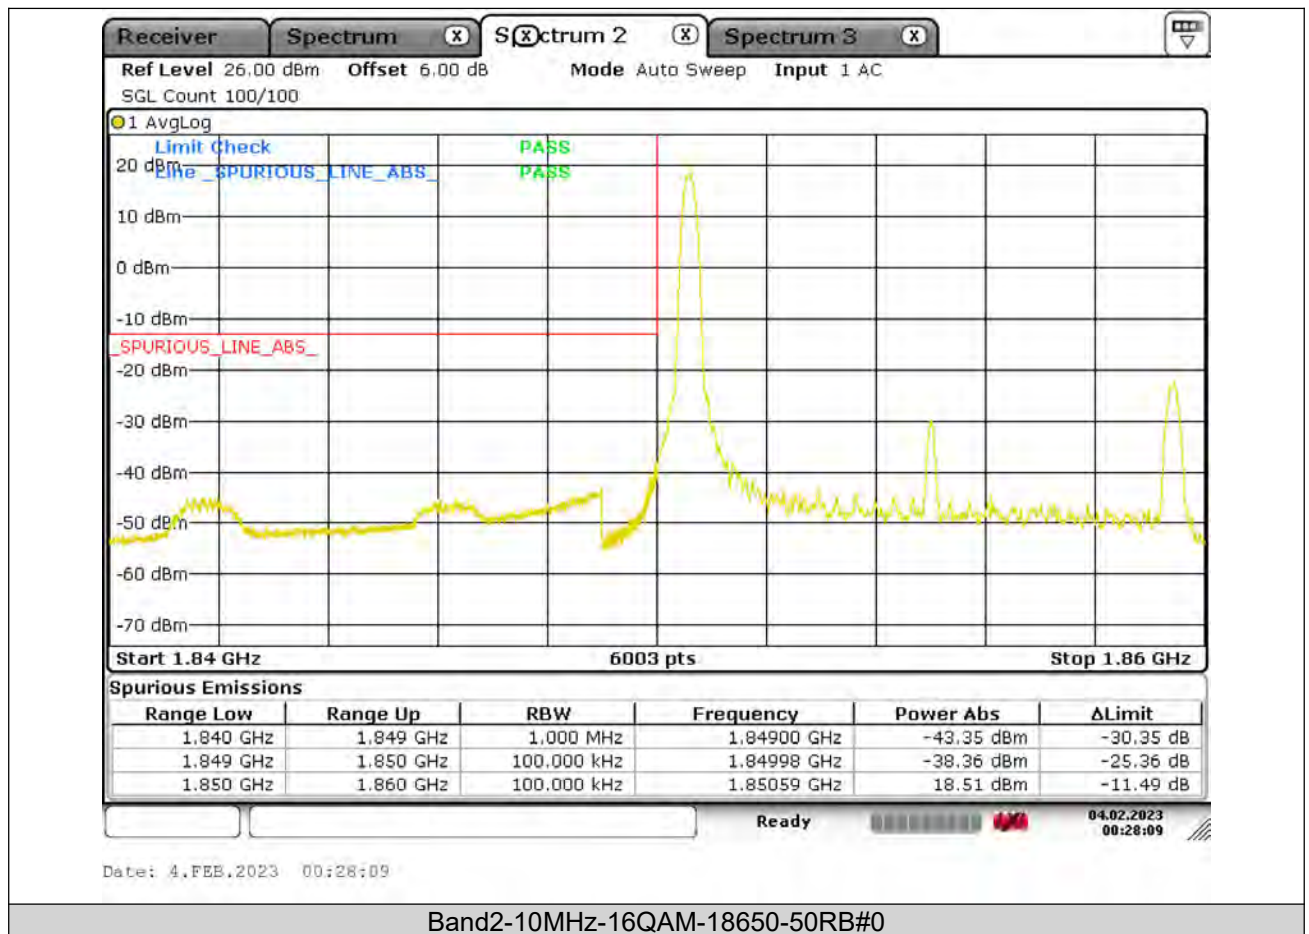



BUREAU
VERITAS


Test Report No.: PSU-QSU2308280314RF02

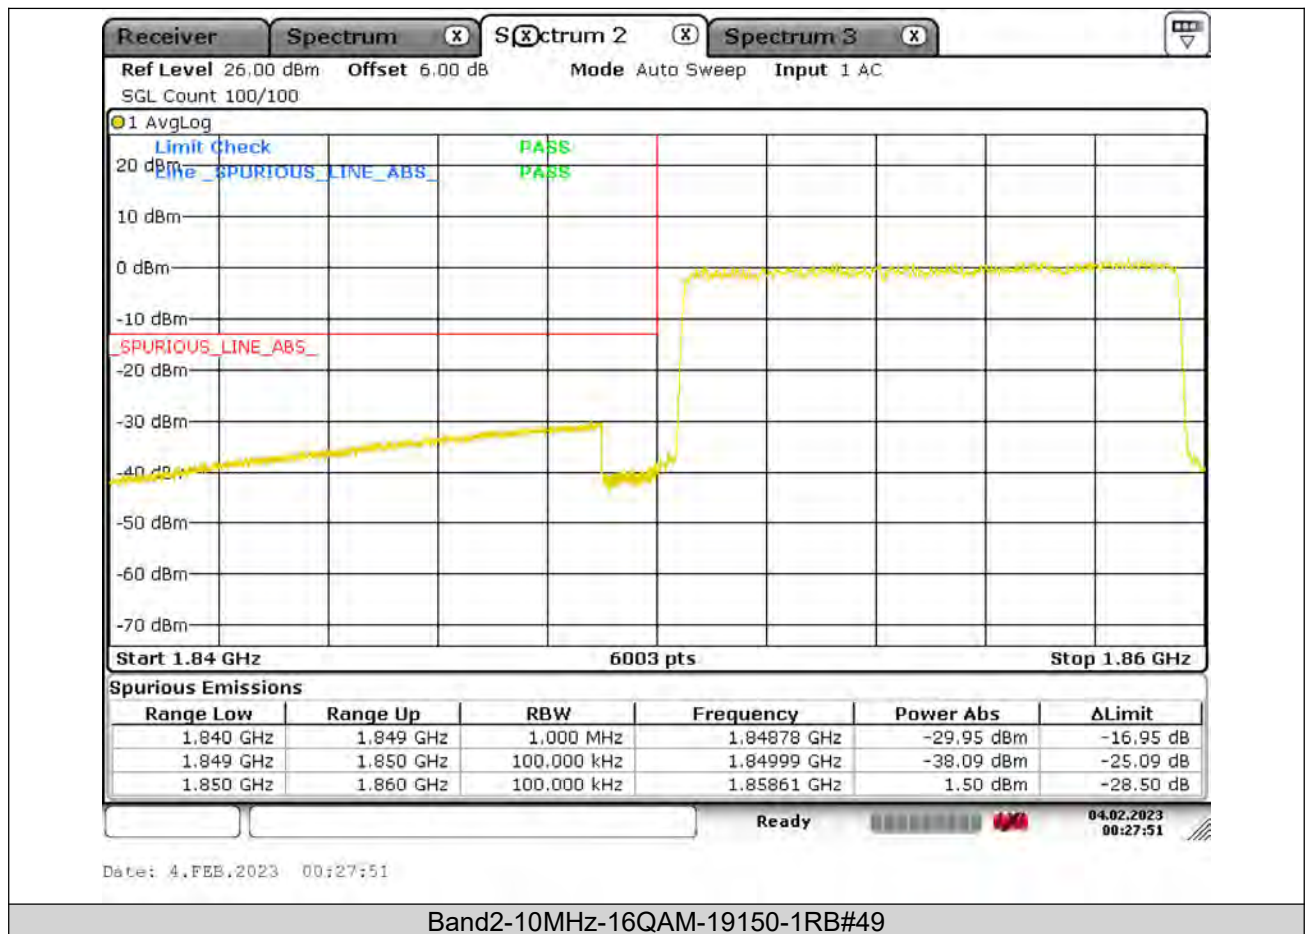



BUREAU
VERITAS


Test Report No.: PSU-QSU2308280314RF02

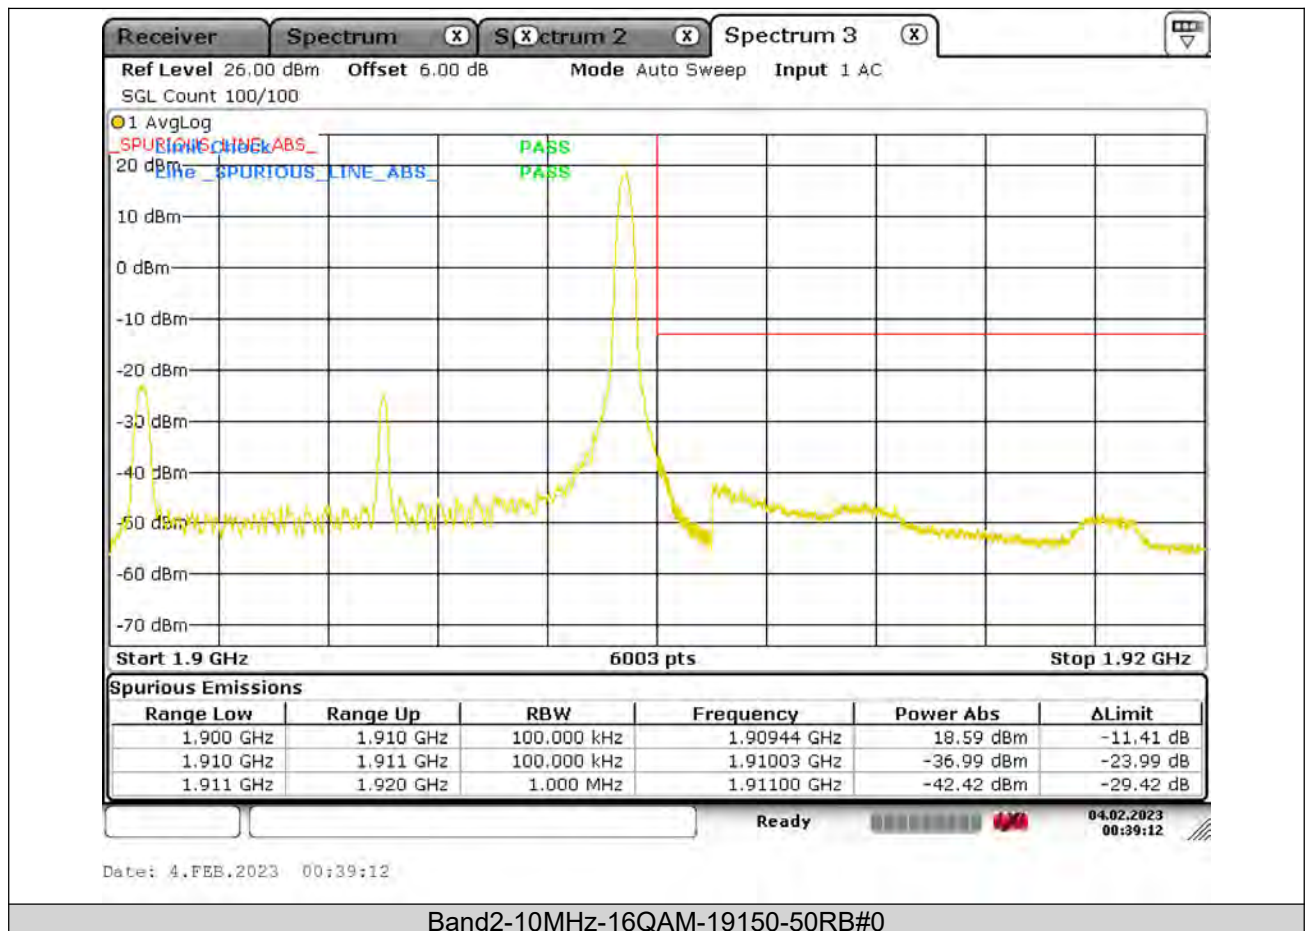



BUREAU
VERITAS


Test Report No.: PSU-QSU2308280314RF02

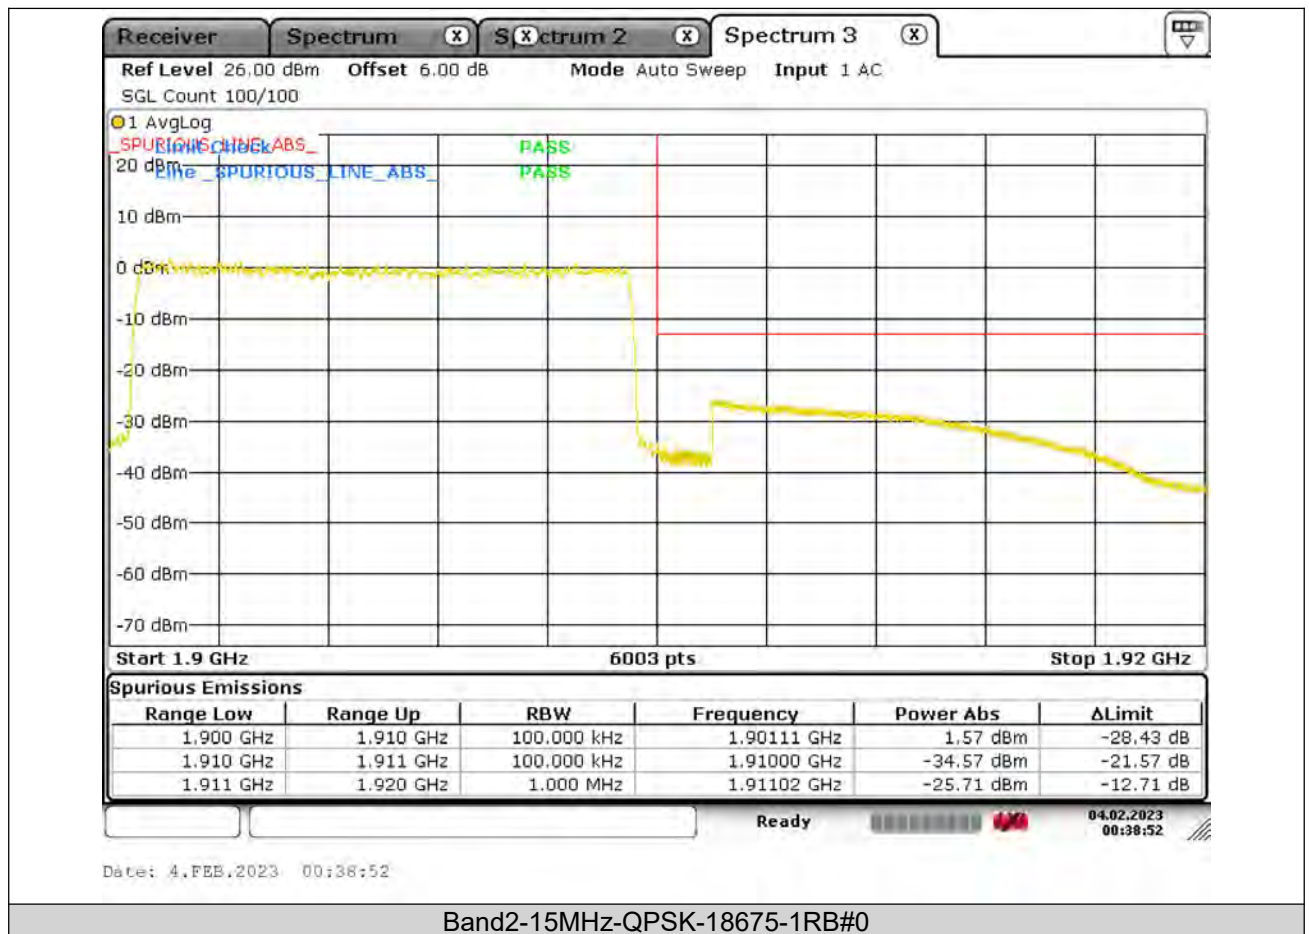



BUREAU
VERITAS


Test Report No.: PSU-QSU2308280314RF02

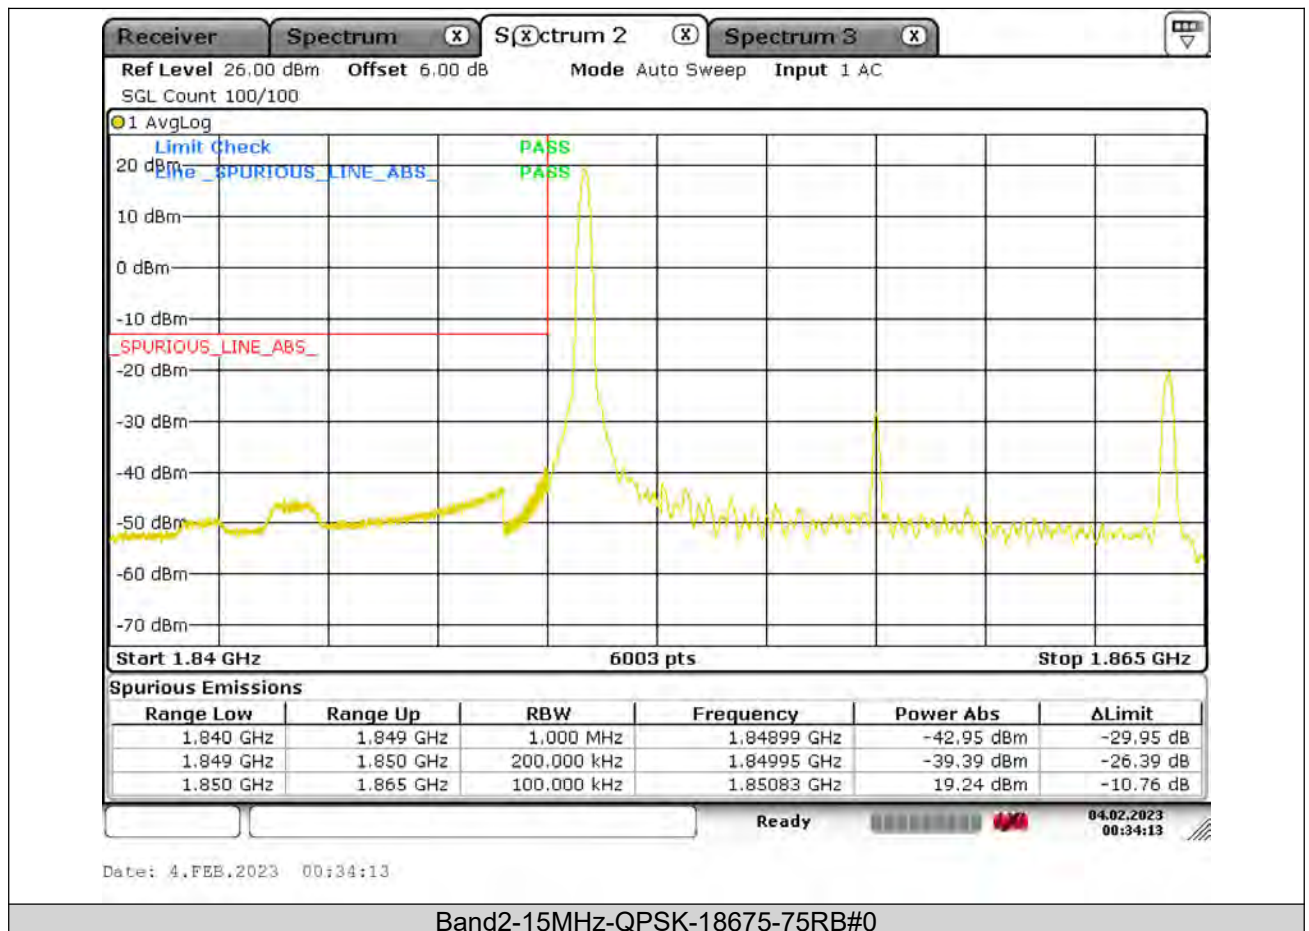



BUREAU
VERITAS


Test Report No.: PSU-QSU2308280314RF02

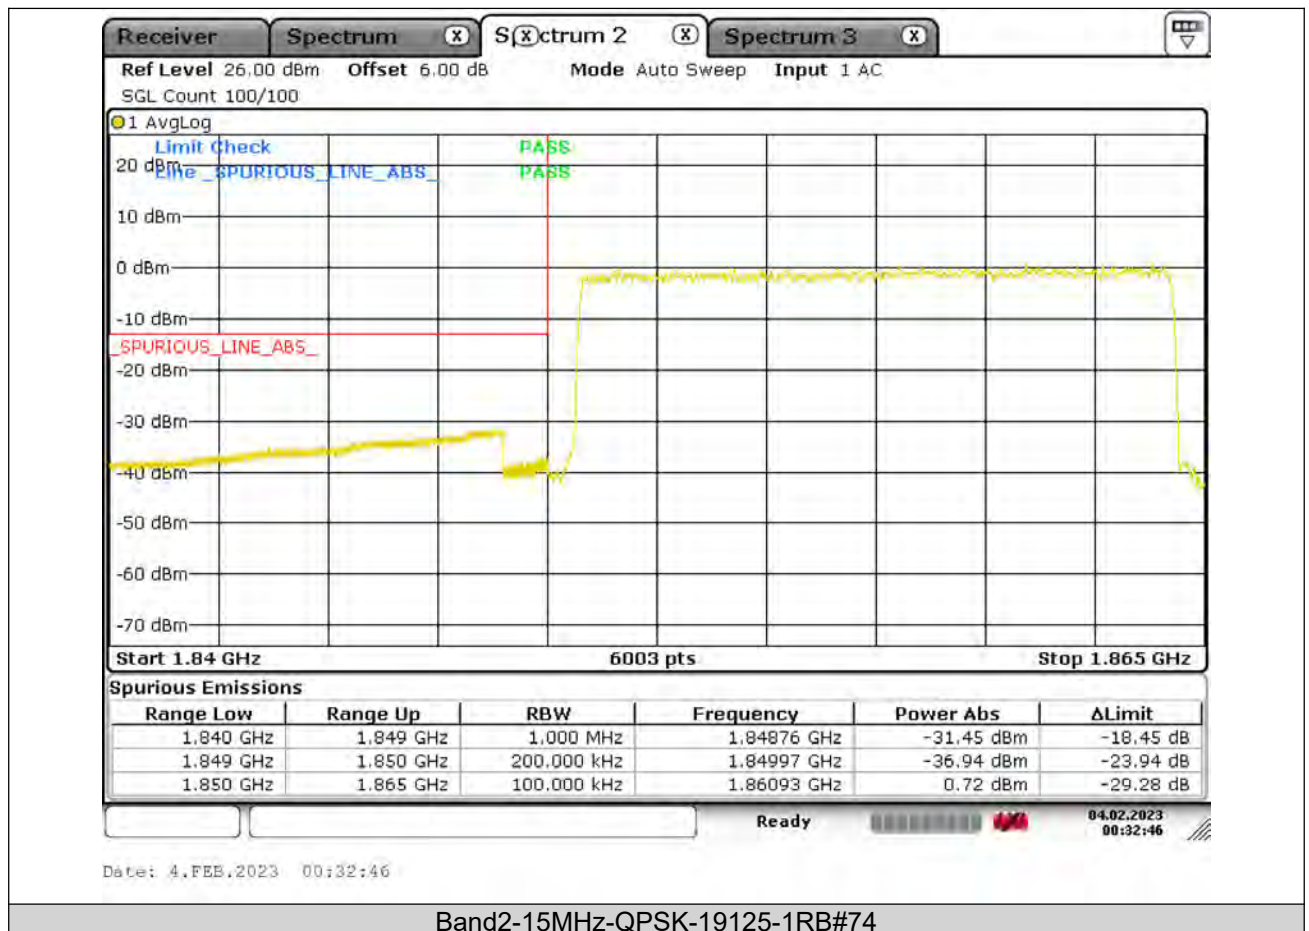



BUREAU
VERITAS


Test Report No.: PSU-QSU2308280314RF02

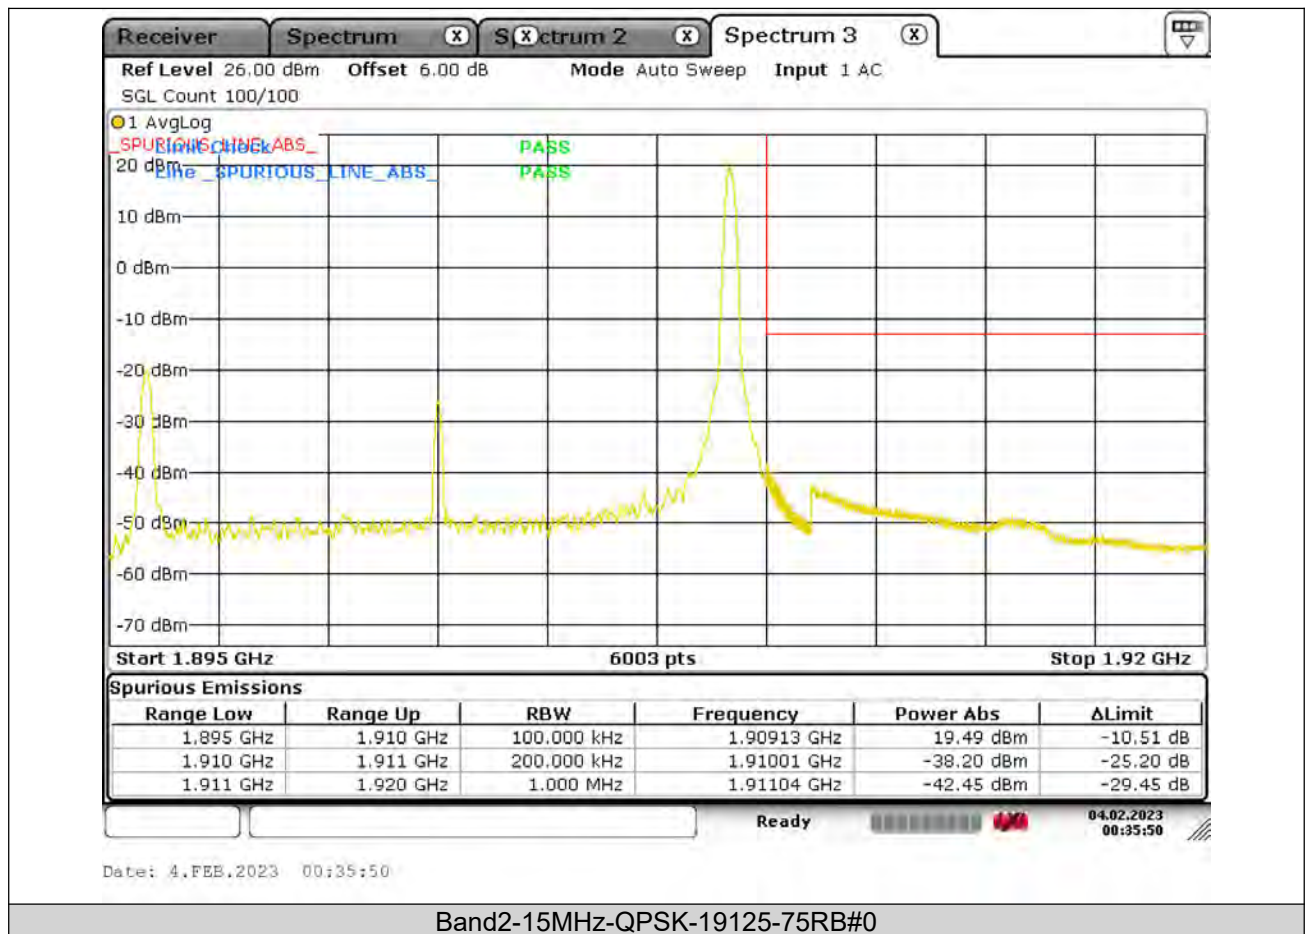



BUREAU
VERITAS


Test Report No.: PSU-QSU2308280314RF02

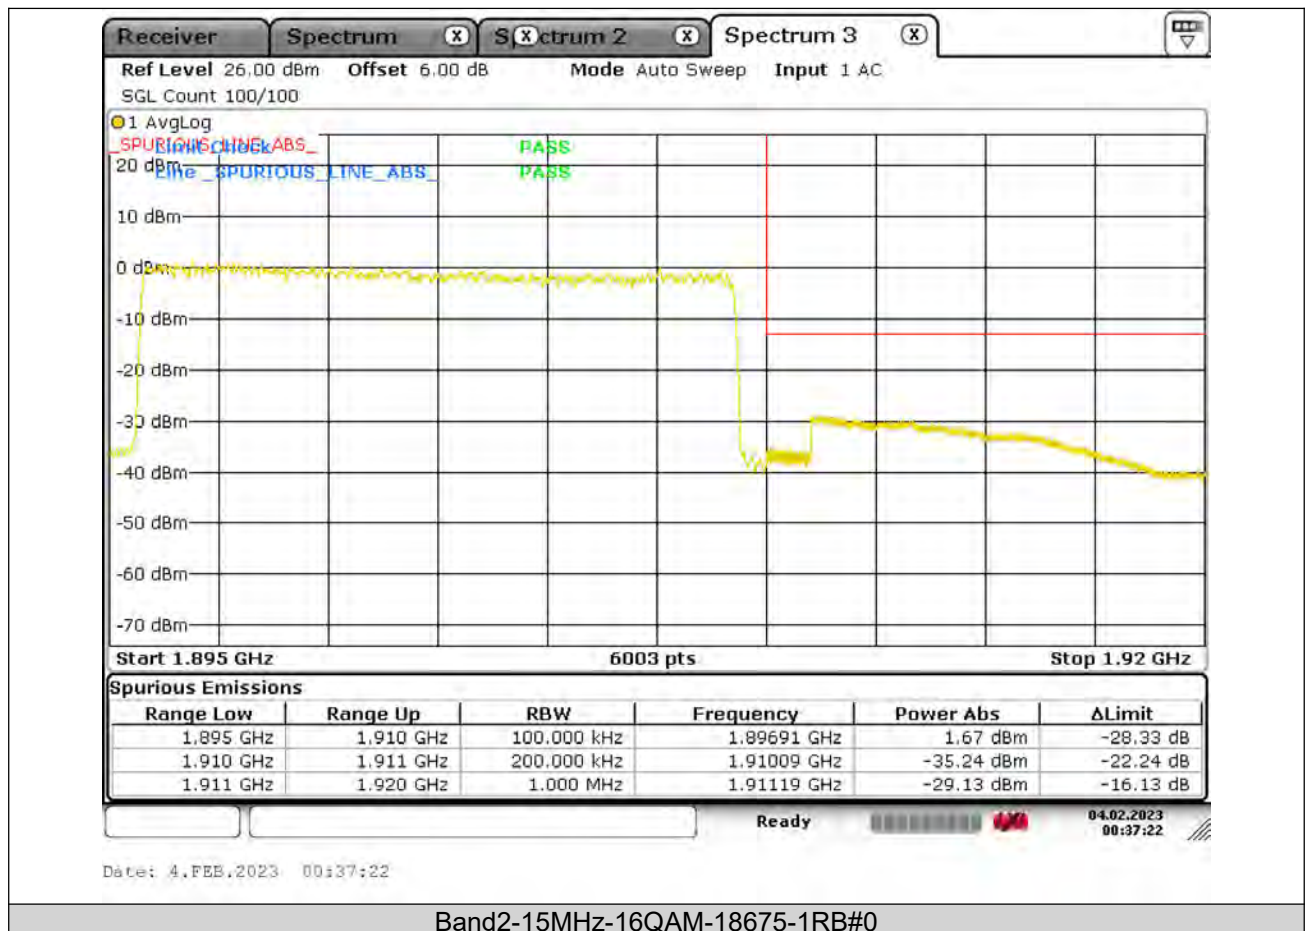



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

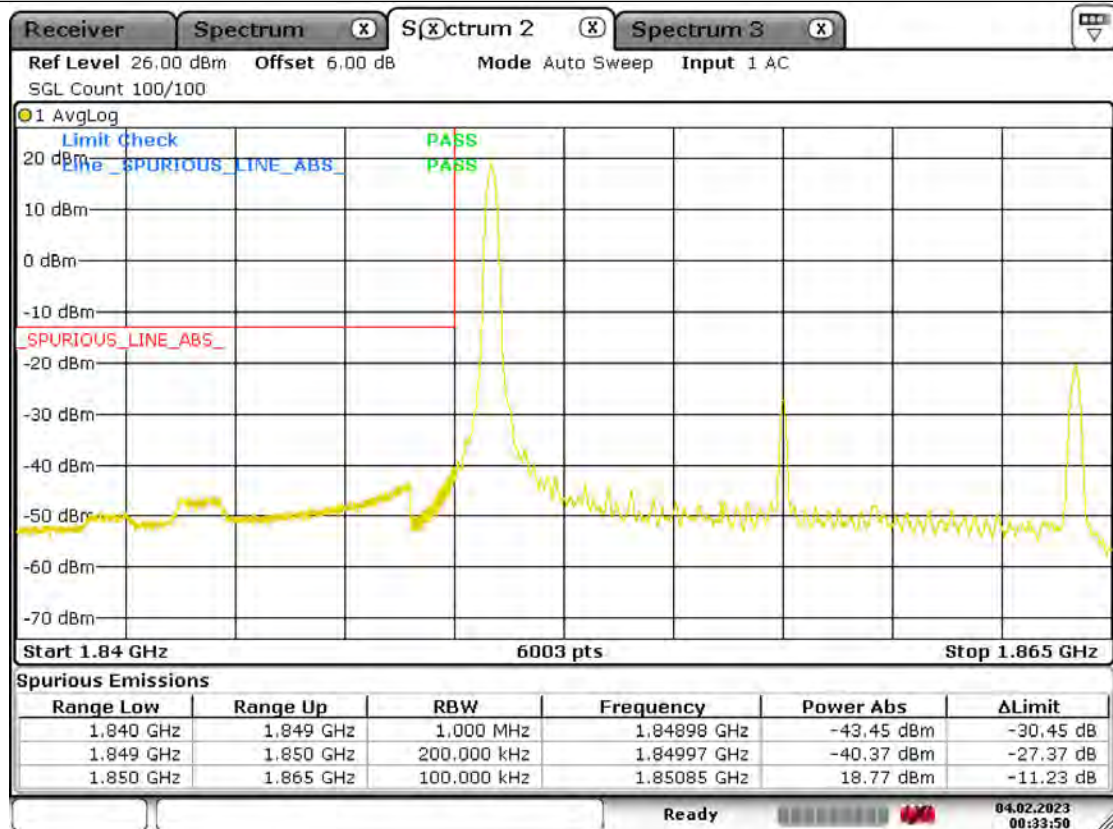


Date: 4.FEB.2023 00:33:50

Band2-15MHz-16QAM-18675-75RB#0



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

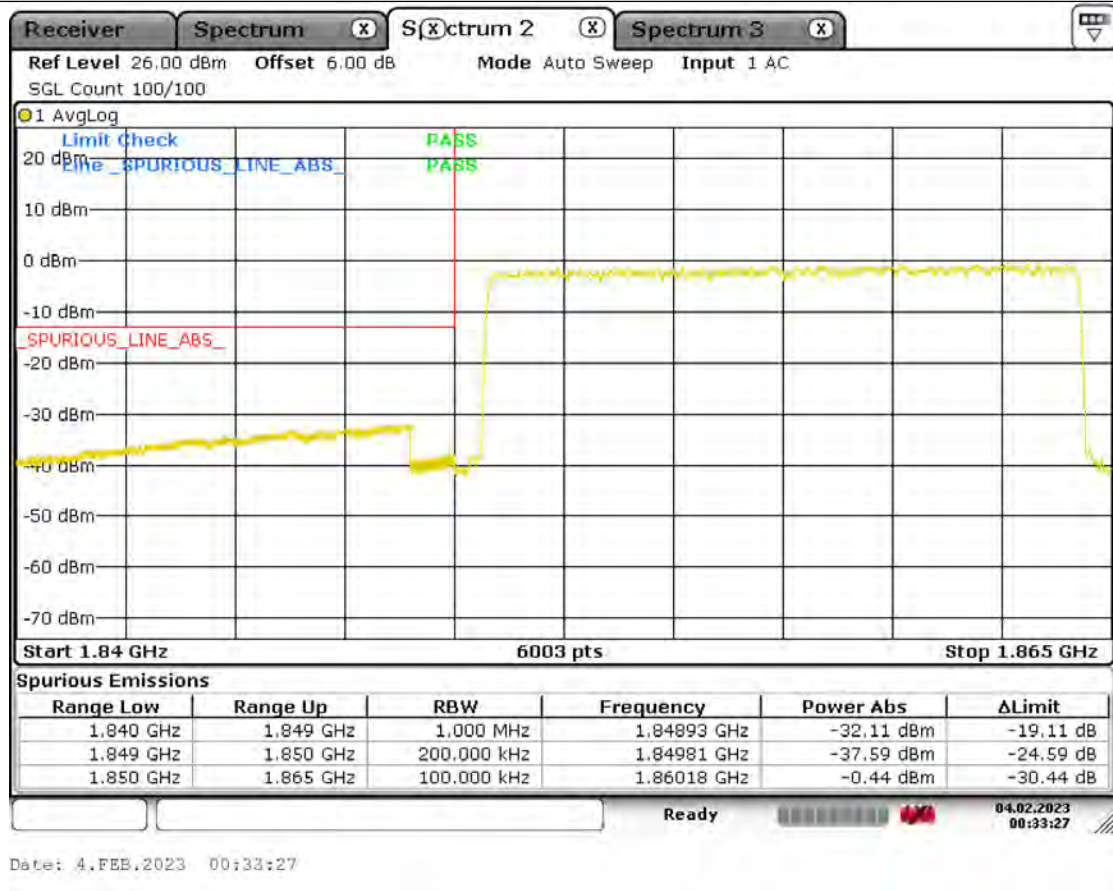


Band2-15MHz-16QAM-19125-1RB#74



BUREAU
VERITAS


Test Report No.: PSU-QSU2308280314RF02

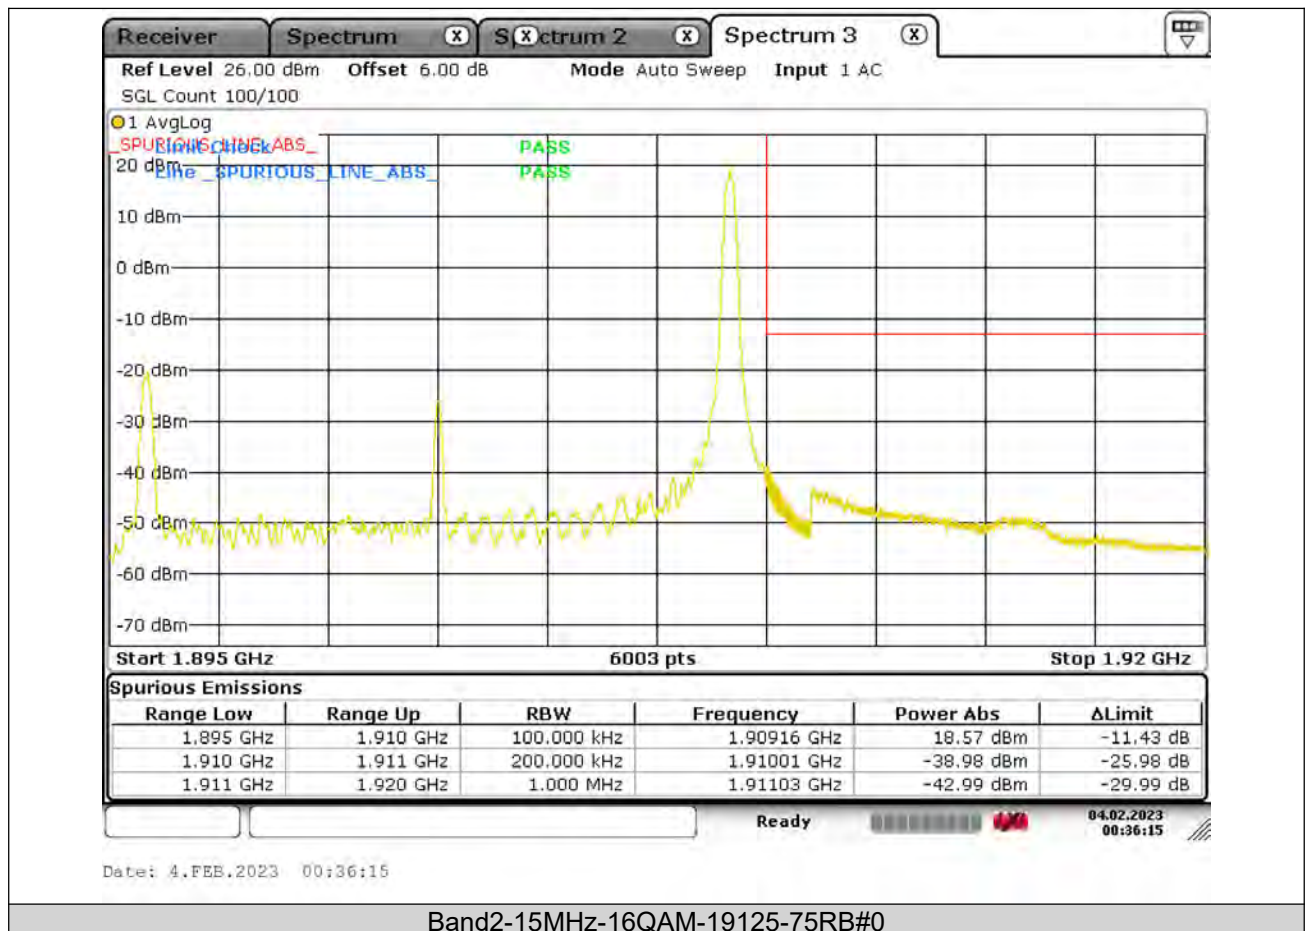



BUREAU
VERITAS


Test Report No.: PSU-QSU2308280314RF02

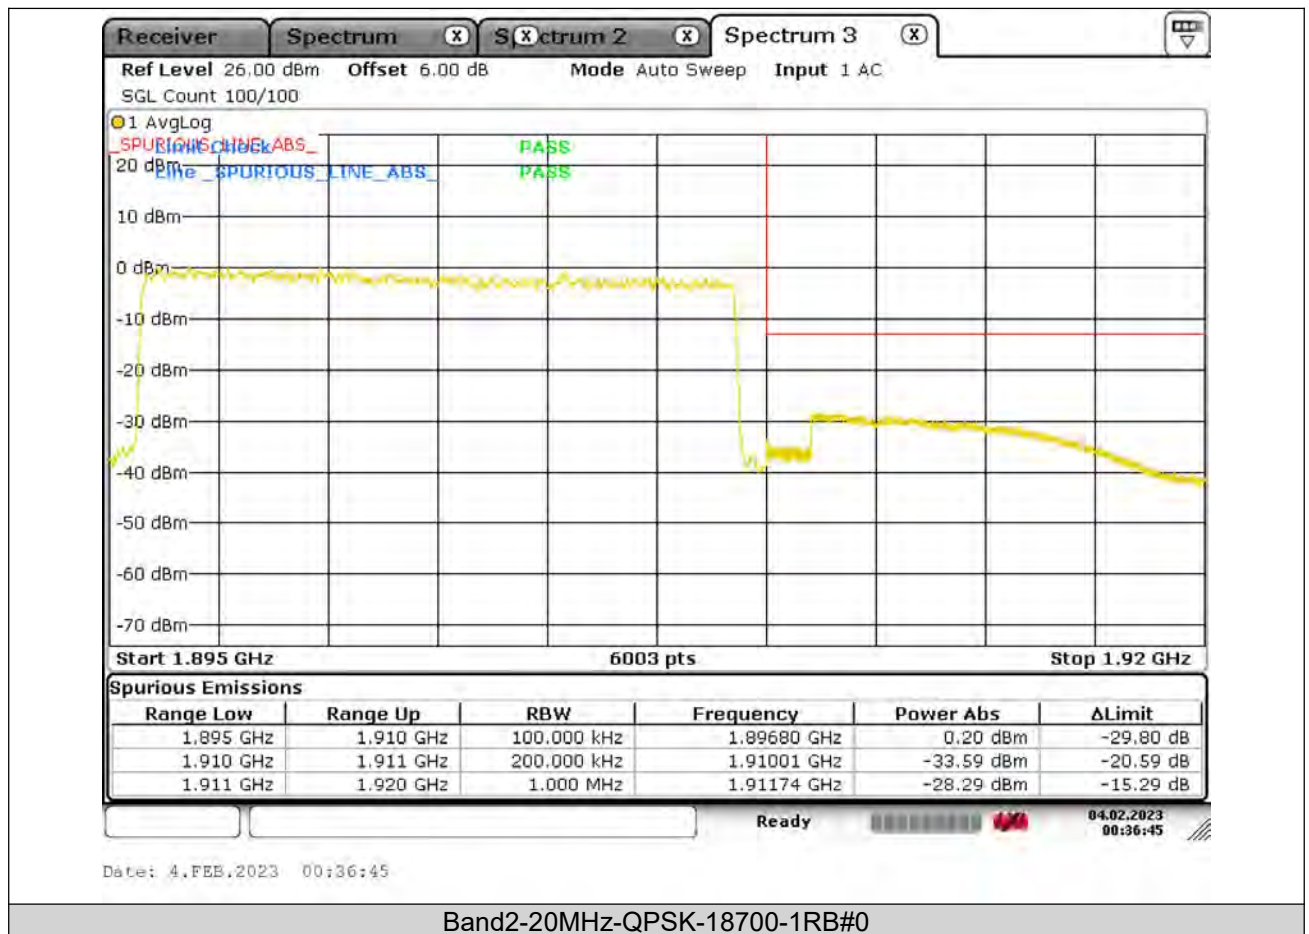



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

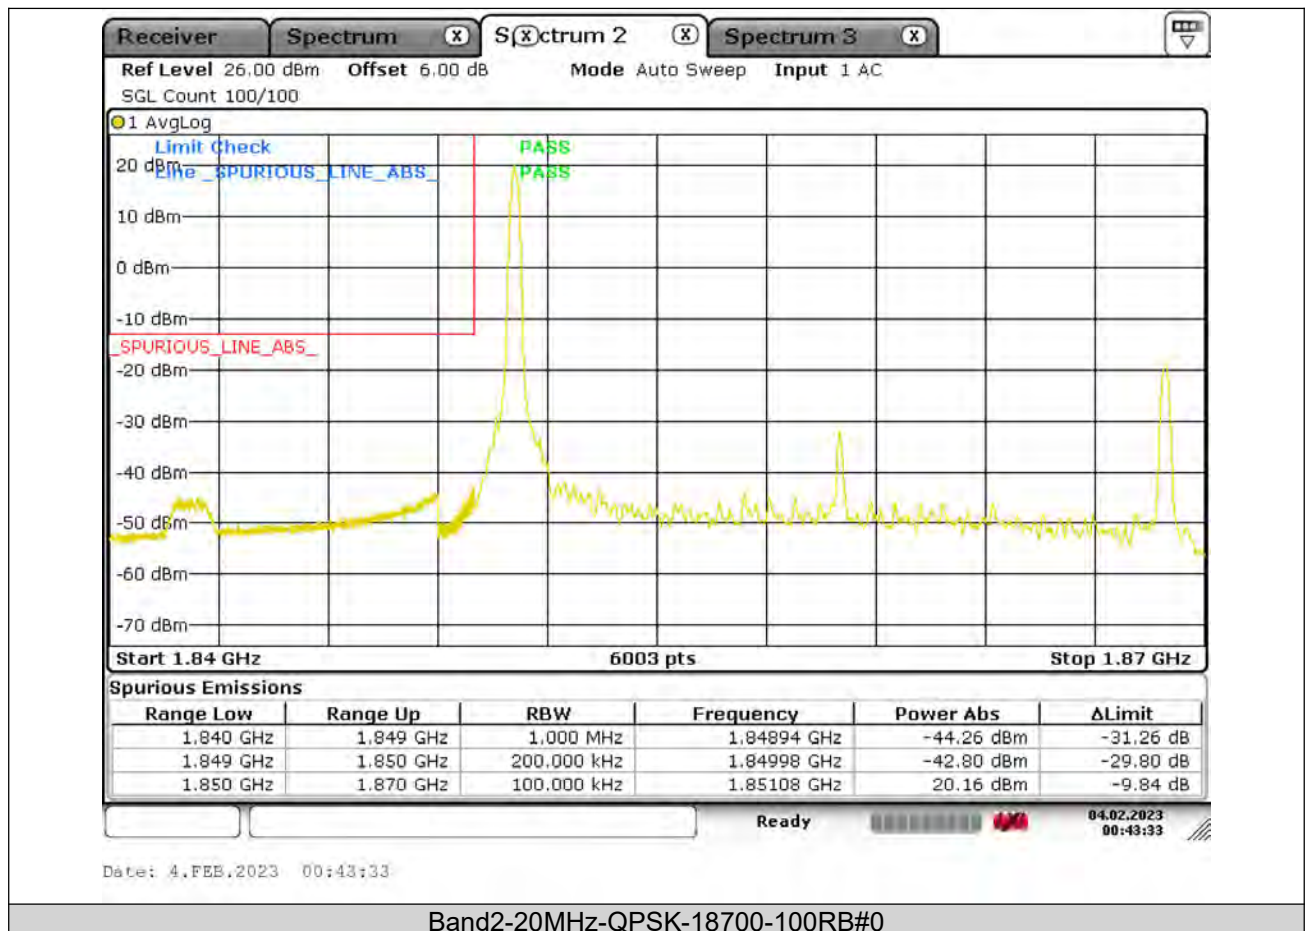



BUREAU
VERITAS

Test Report No.: PSU-QSU2308280314RF02

