


Appendix Test Data

Report No.:	1812C60295712501-01	Test Sample No.:	1-2-2
Start Test Date:	2026-6-3	Finish Test Date:	2026-6-10
Test Engineer:	Pearl Ao	Auditor:	Justin Feng
Temperature:	26°C	Relative Humidity:	58%
Pressure:	101kPa		

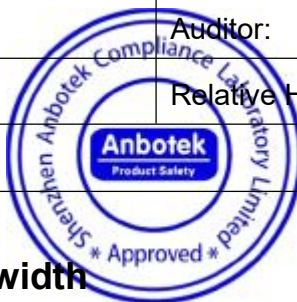

Appendix A: 20dB Bandwidth

Test Result

Test Mode	Antenna	Frequency [MHz]	20db EBW[MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
DH5	Ant1	2402	0.951	2401.499	2402.450	---	---
DH5	Ant1	2441	0.960	2440.499	2441.459	---	---
DH5	Ant1	2480	0.963	2479.493	2480.456	---	---

Test Graphs



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Appendix B: 99% Occupied Bandwidth

Test Result

Test Mode	Antenna	Frequency [MHz]	OCB [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
DH5	Ant1	2402	0.86425	2401.5297	2402.3939	---	---
DH5	Ant1	2441	0.85245	2440.5328	2441.3853	---	---
DH5	Ant1	2480	0.86364	2479.5291	2480.3927	---	---

Test Graphs



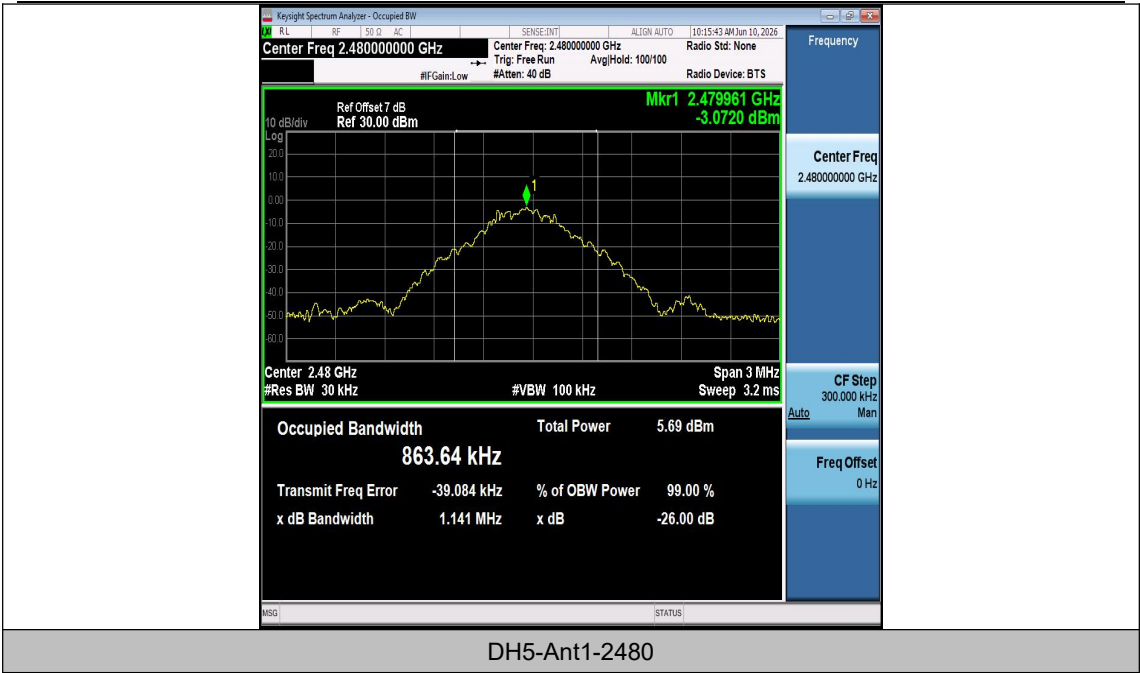

Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Appendix C: Maximum Conducted Output Power

Test Result Peak

Test Mode	Antenna	Frequency[MHz]	Conducted Peak Power[dBm]	Conducted Limit[dBm]	Verdict
DH5	Ant1	2402	-0.28	≤20.97	PASS
DH5	Ant1	2441	-0.44	≤20.97	PASS
DH5	Ant1	2480	-0.78	≤20.97	PASS


Test Graphs

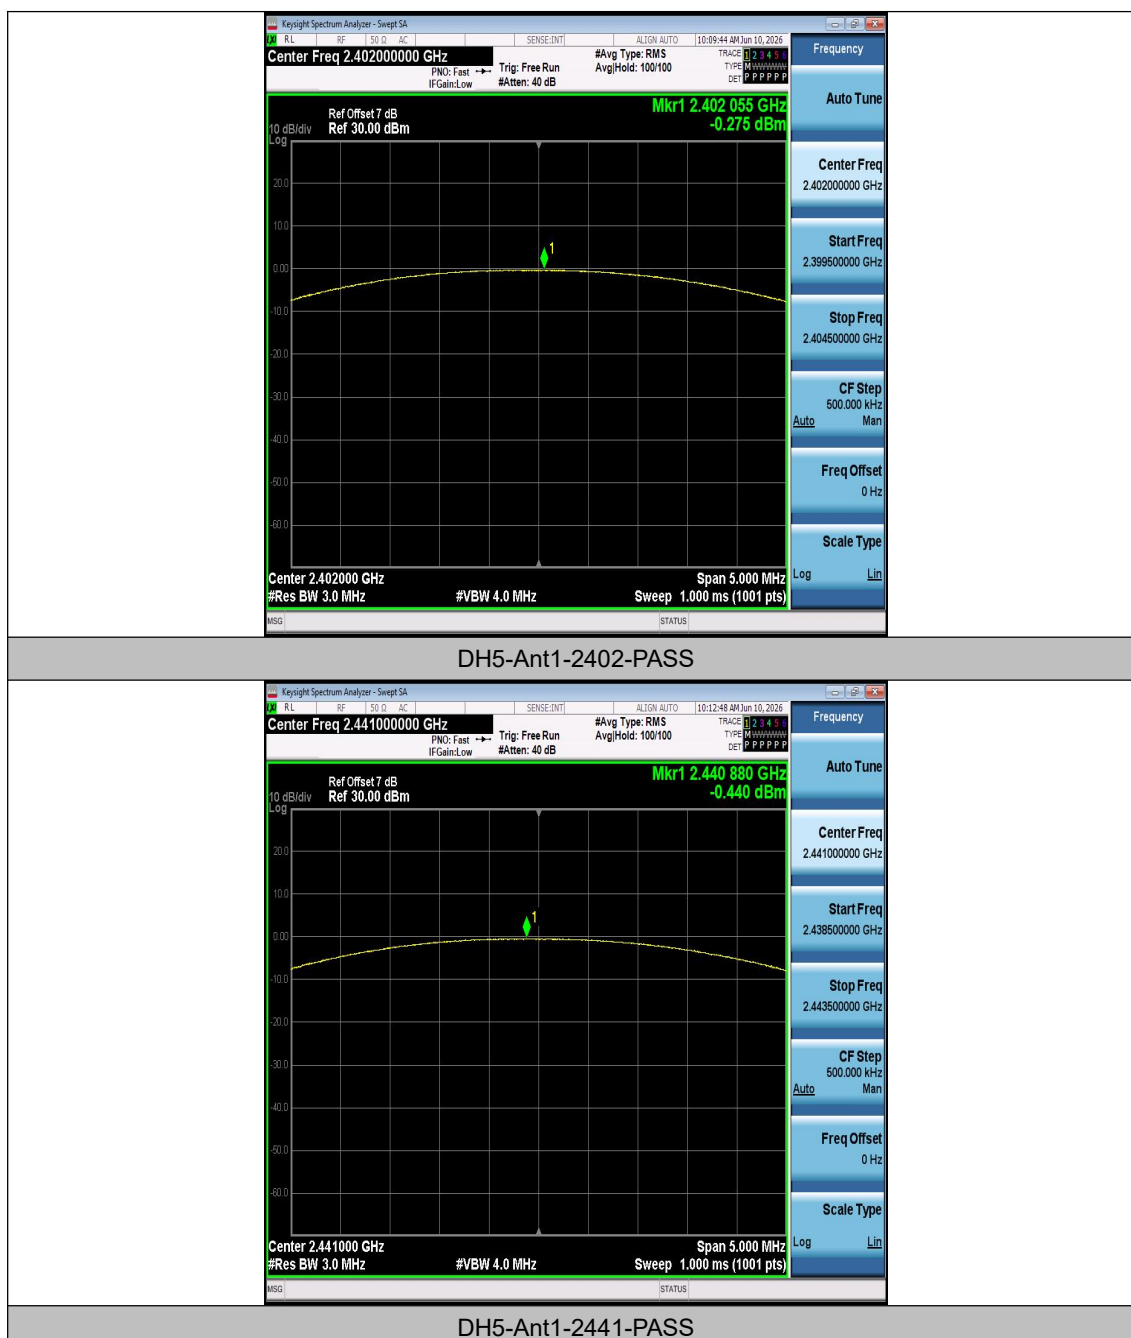

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

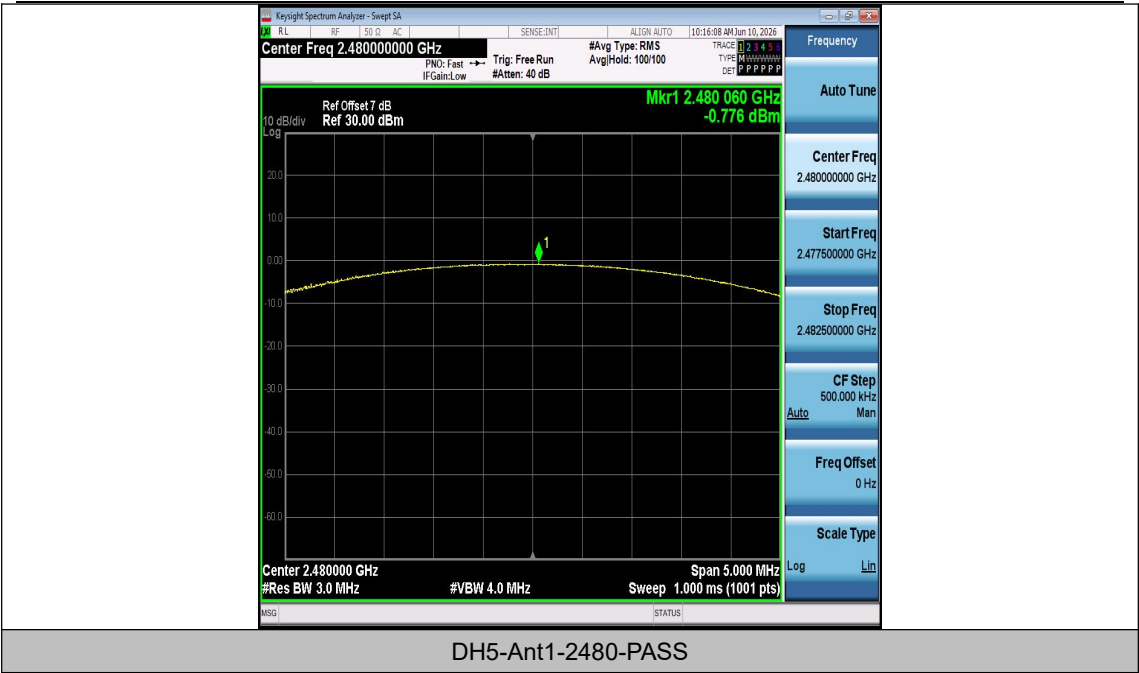

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Appendix D: Carrier frequency separation

Test Result

Test Mode	Antenna	Frequency [MHz]	Result [MHz]	Limit[MHz]	Verdict
DH5	Ant1	Hop	0.992	≥0.963	PASS

Note: For conducted power less than 0.125 W(20.97 dBm), the limit can be set using hopping channel carrier frequencies that are separated by 25 kHz or two thirds of the 20 dB bandwidth of the hopping channel, whichever is greater.

Test Graphs

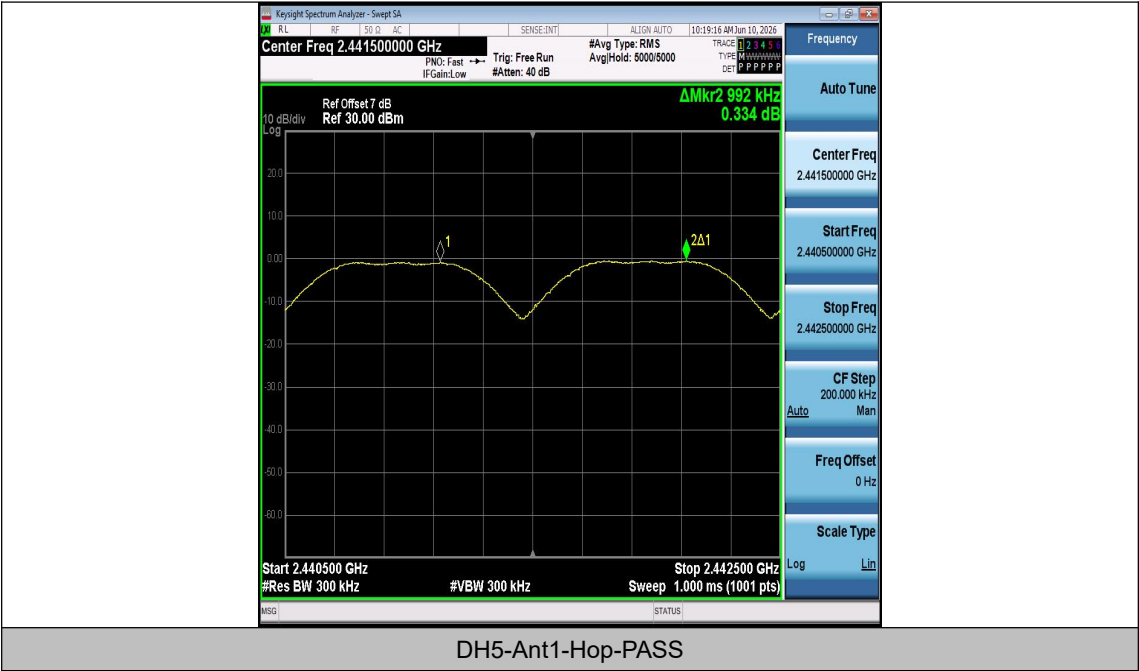


Appendix E: Dwell Time

Test Result

Test Mode	Antenna	Frequency [MHz]	Burst Width [ms]	Total Hops [Num]	Result [s]	Limit [s]	Verdict
DH5	Ant1	Hop	2.908	99	0.288	≤0.4	PASS

Test Graphs

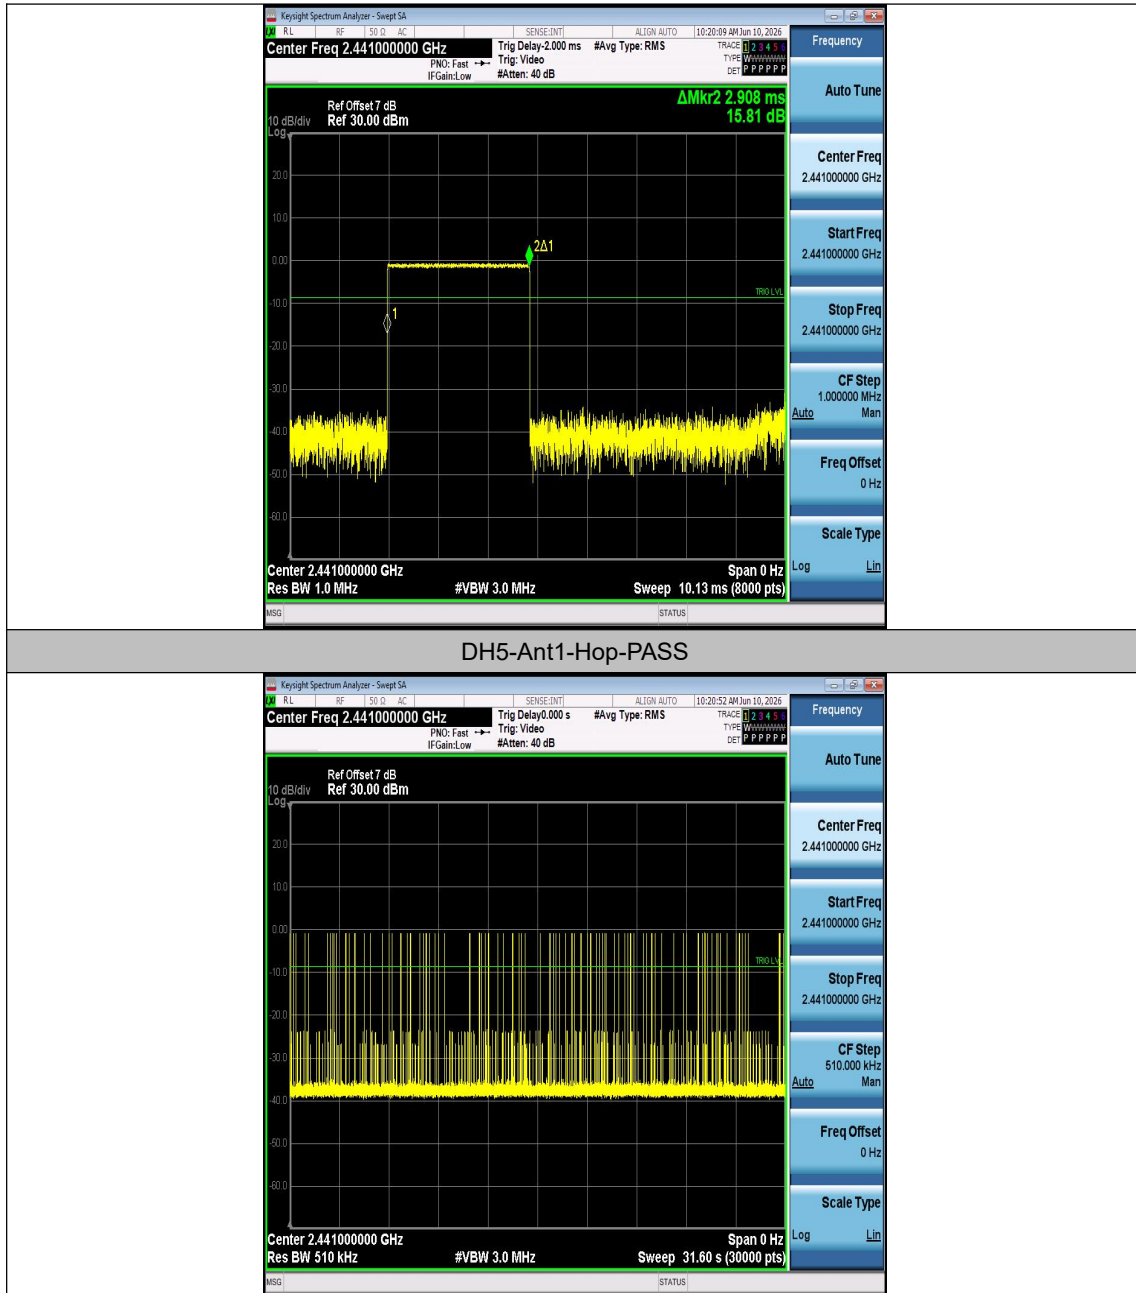

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix F: Number of Hopping Channel

Test Result

Test Mode	Antenna	Frequency [MHz]	Result [Num]	Limit [Num]	Verdict
DH5	Ant1	Hop	79	≥15	PASS

Test Graphs

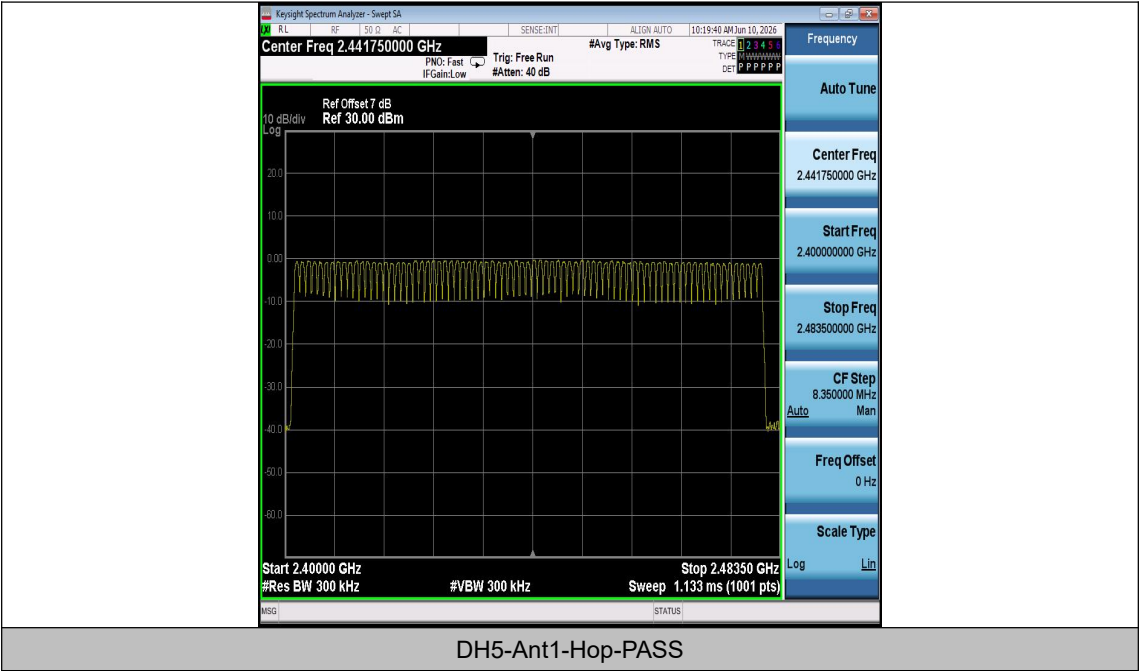


Appendix G: Conducted Band edge

Test Result

Test Mode	Antenna	Ch. Name	Frequency [MHz]	Ref. Level [dBm]	Result [dBm]	Limit [dBm]	Verdict
DH5	Ant1	Low	2402	-0.75	-49.63	≤-20.75	PASS
DH5	Ant1	High	2480	-1.39	-38.74	≤-21.39	PASS
DH5	Ant1	Low	Hop_2402	-0.92	-49.58	≤-20.92	PASS
DH5	Ant1	High	Hop_2480	-1.07	-45.98	≤-21.07	PASS


Test Graphs

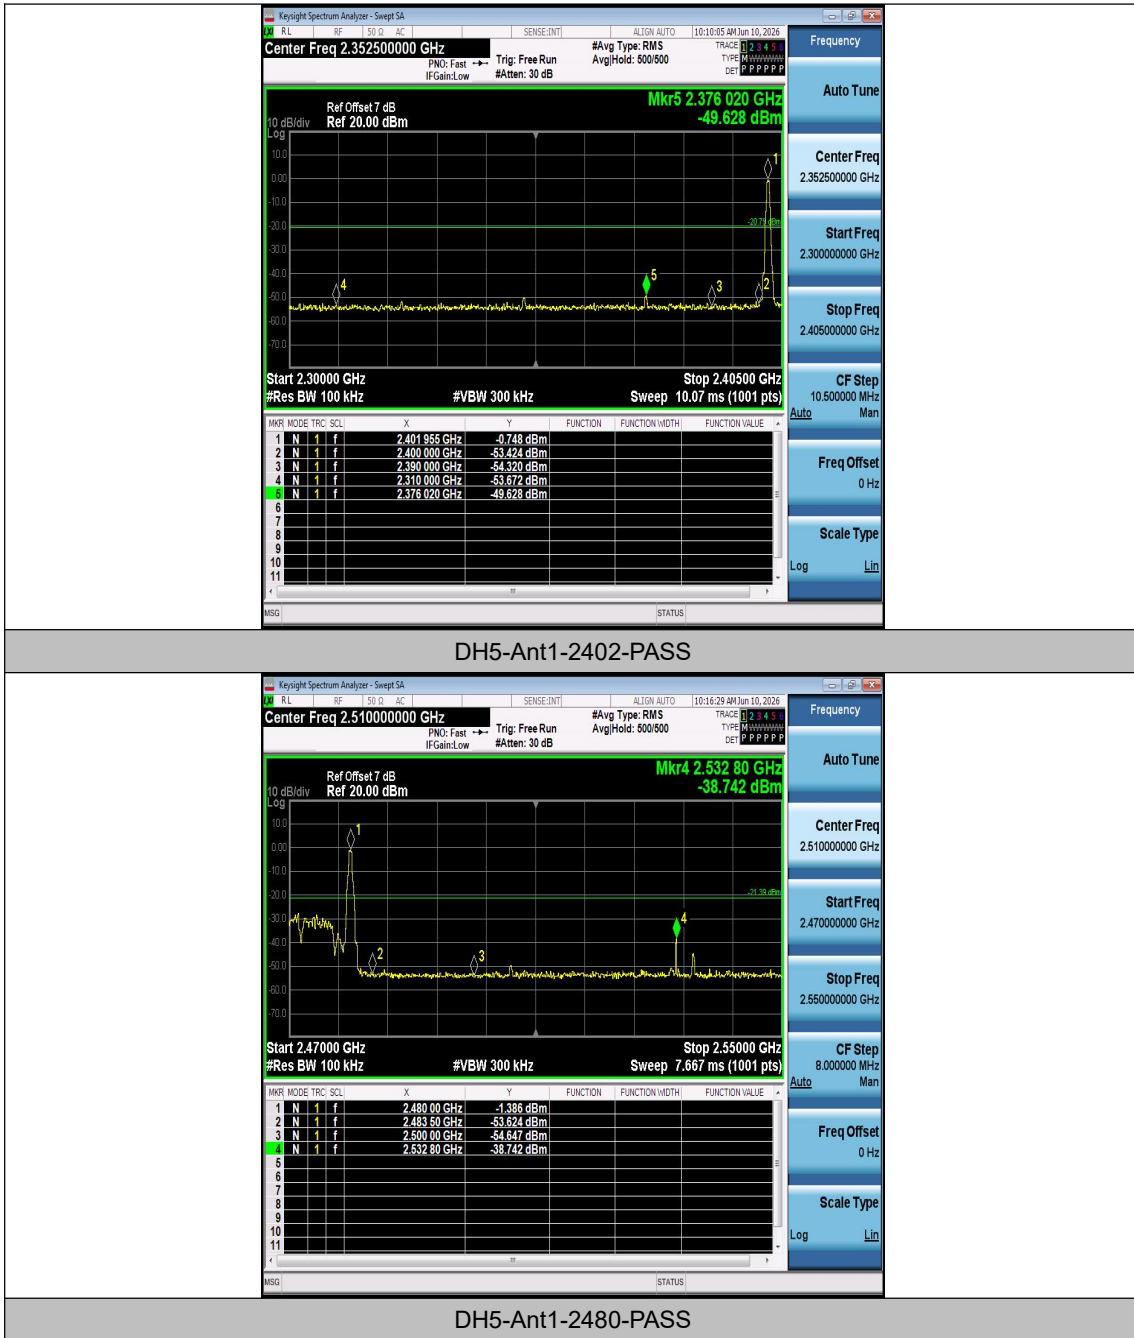

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

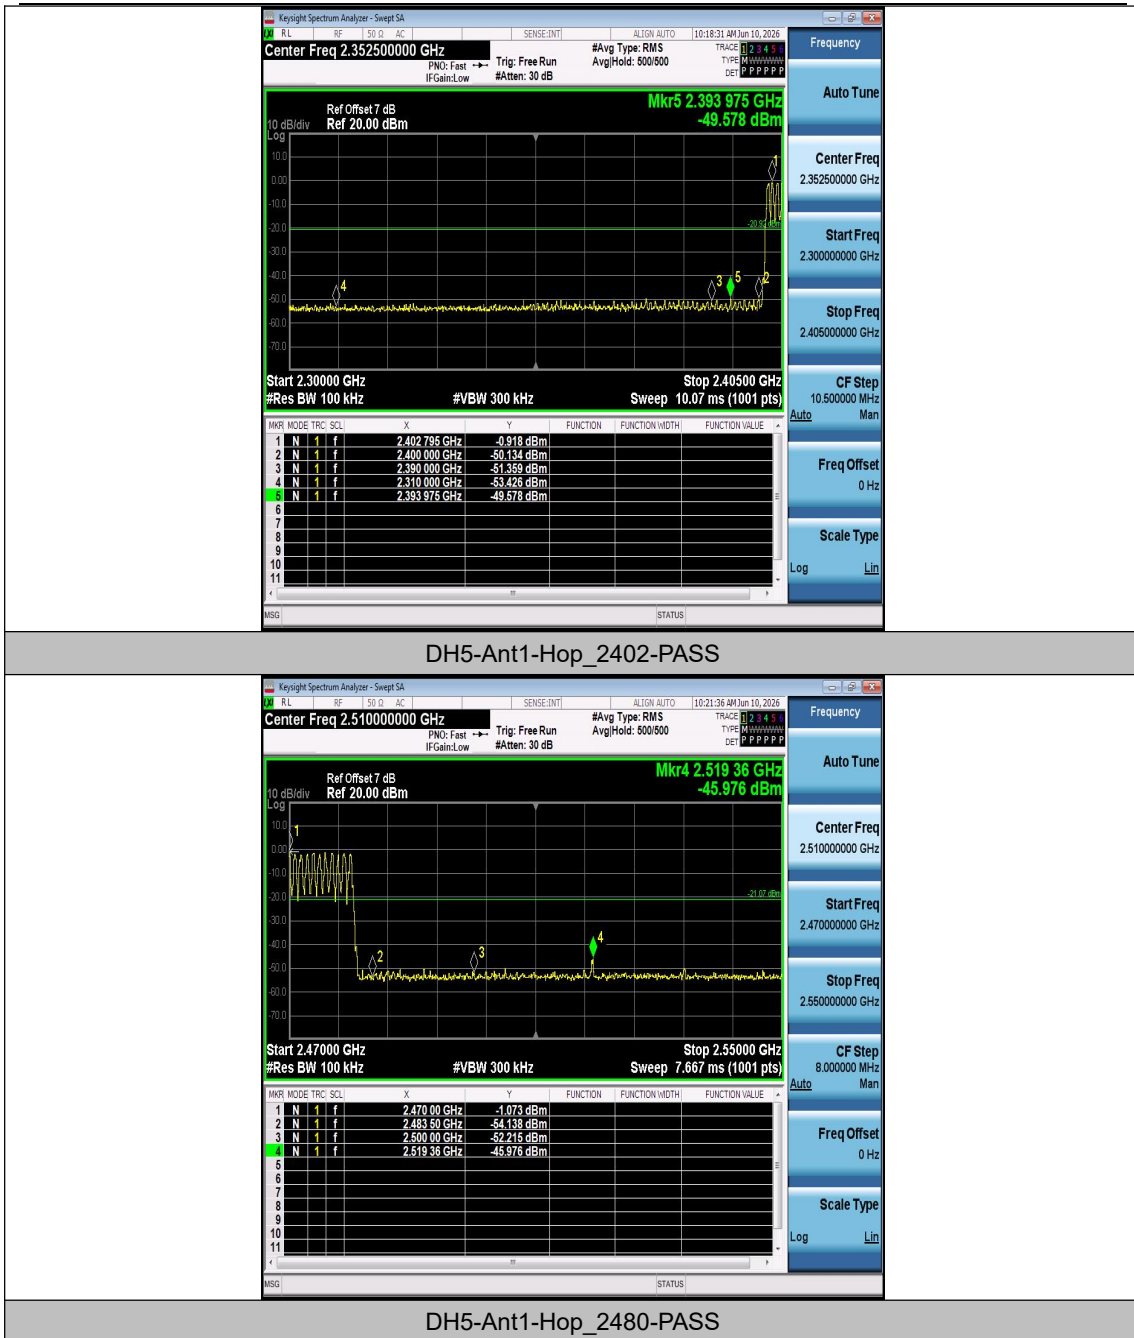

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Appendix H: Conducted Spurious Emission

Test Result

Test Mode	Antenna	Frequency[MHz]	Freq. Range [MHz]	Ref. Level [dBm]	Result [dBm]	Limit [dBm]	Verdict
DH5	Ant1	2402	0~Reference	-0.93	-0.93	---	PASS
DH5	Ant1	2402	30~1000	-0.93	-52.14	≤-20.93	PASS
DH5	Ant1	2402	1000~26500	-0.93	-29.39	≤-20.93	PASS
DH5	Ant1	2441	0~Reference	-1.12	-1.12	---	PASS
DH5	Ant1	2441	30~1000	-1.12	-52.71	≤-21.12	PASS
DH5	Ant1	2441	1000~26500	-1.12	-27.82	≤-21.12	PASS
DH5	Ant1	2480	0~Reference	-1.32	-1.32	---	PASS
DH5	Ant1	2480	30~1000	-1.32	-52.55	≤-21.32	PASS
DH5	Ant1	2480	1000~26500	-1.32	-27.21	≤-21.32	PASS

Remark:Regarding the spurious emissions from 30MHz to 26.5GHz, the cable loss have been set in the 'Input Correction' of the Spectrum Analyzer during the test.


Test Graphs

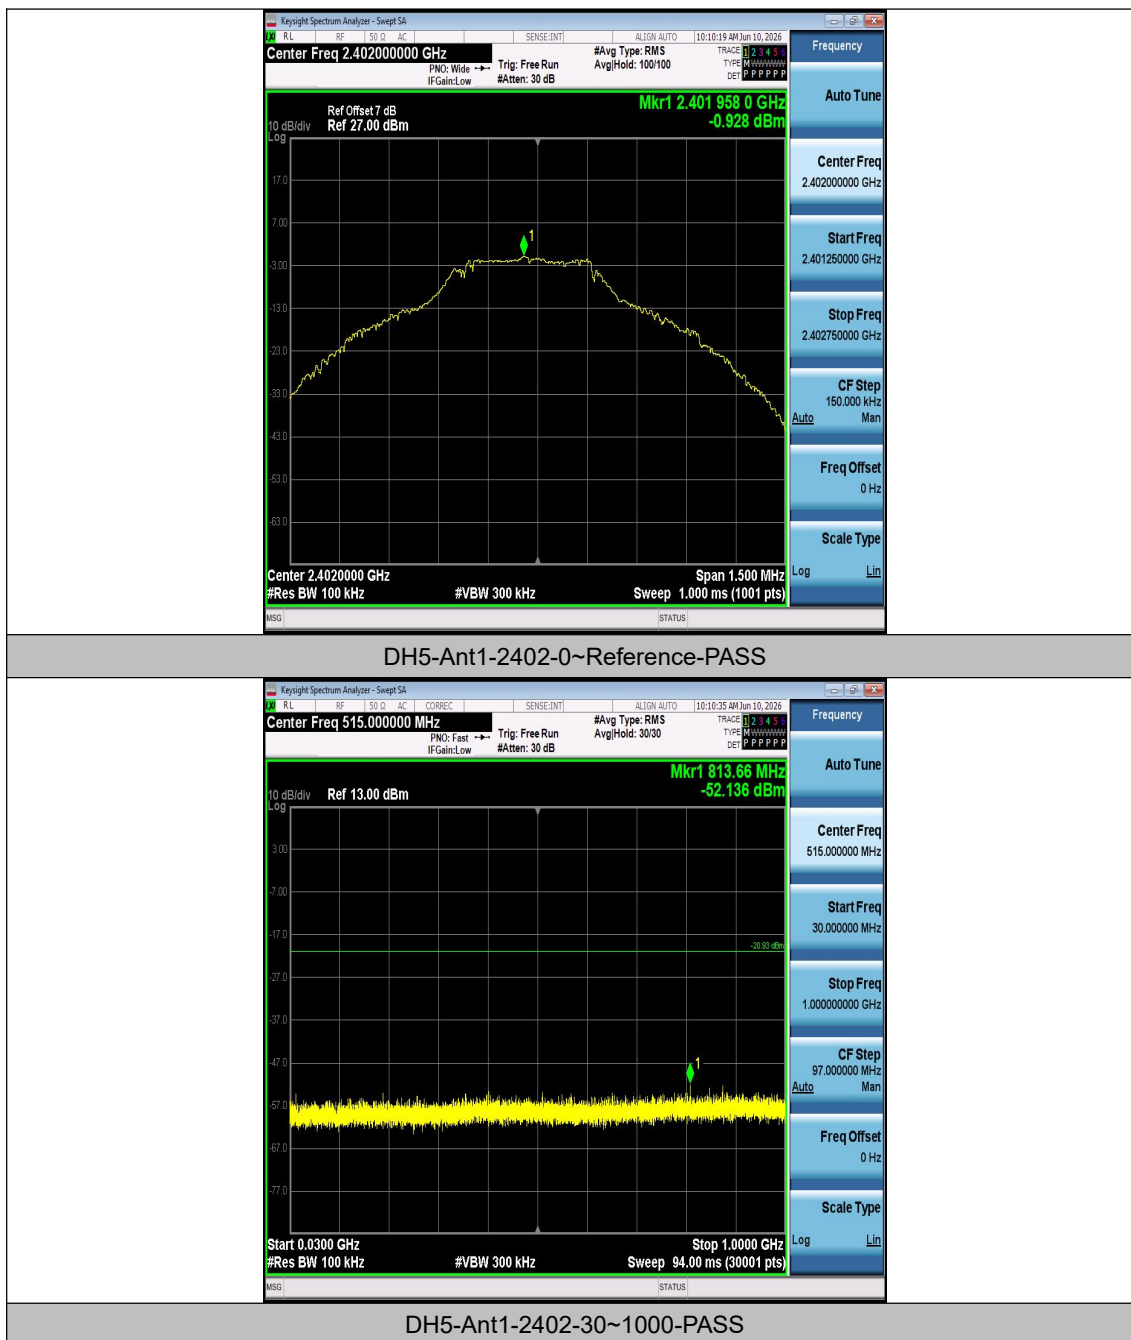

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

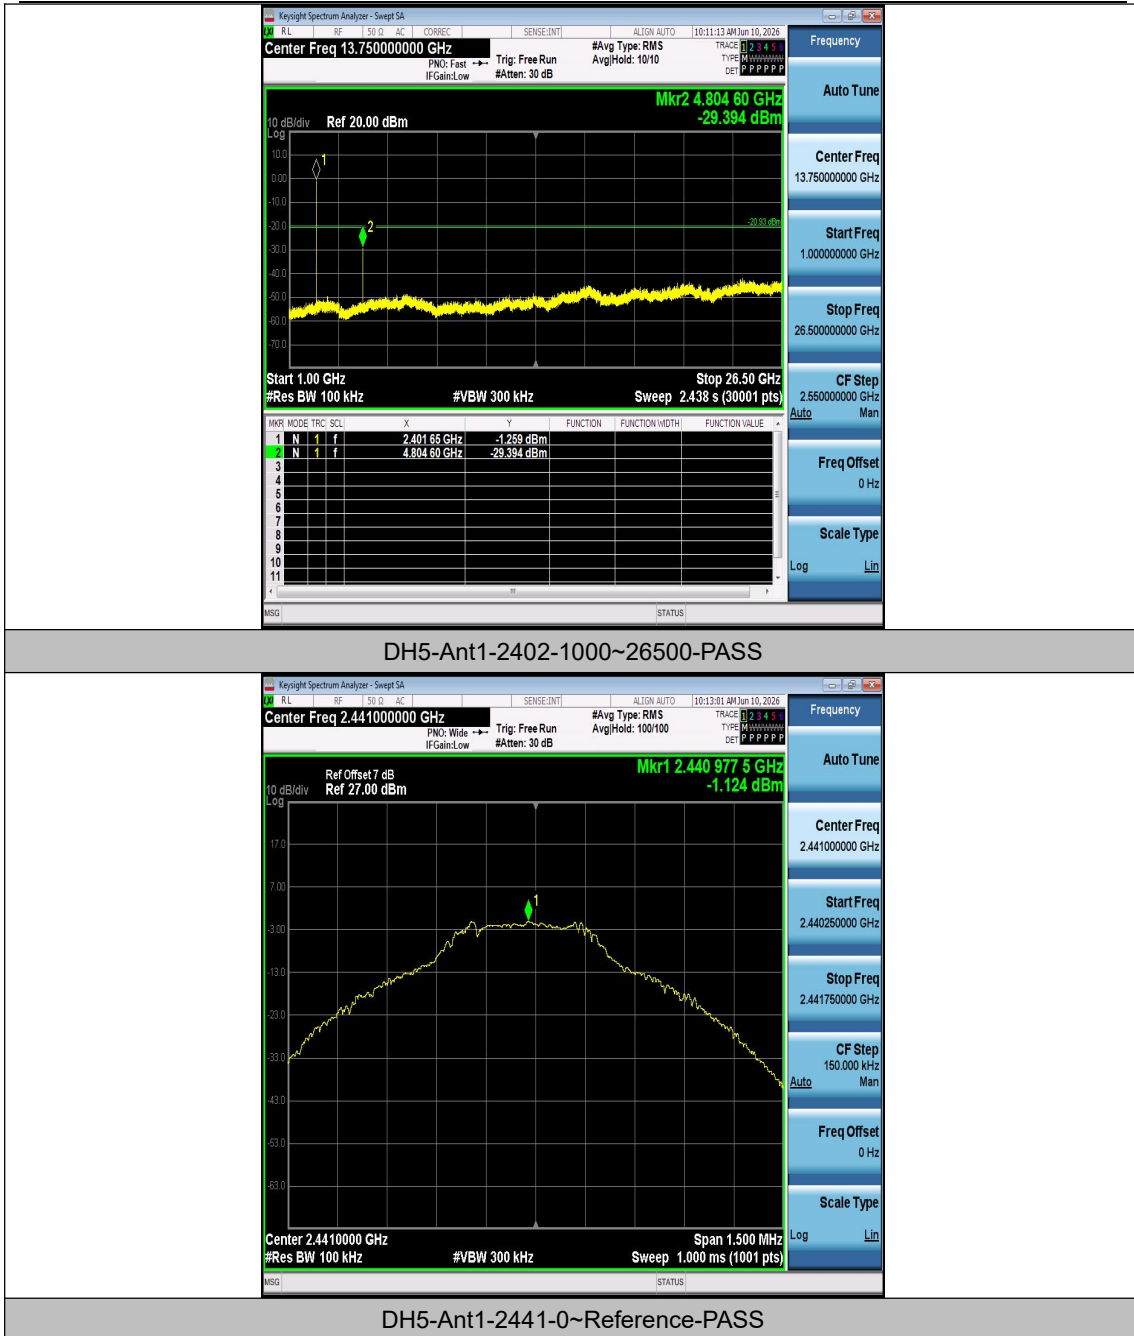


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

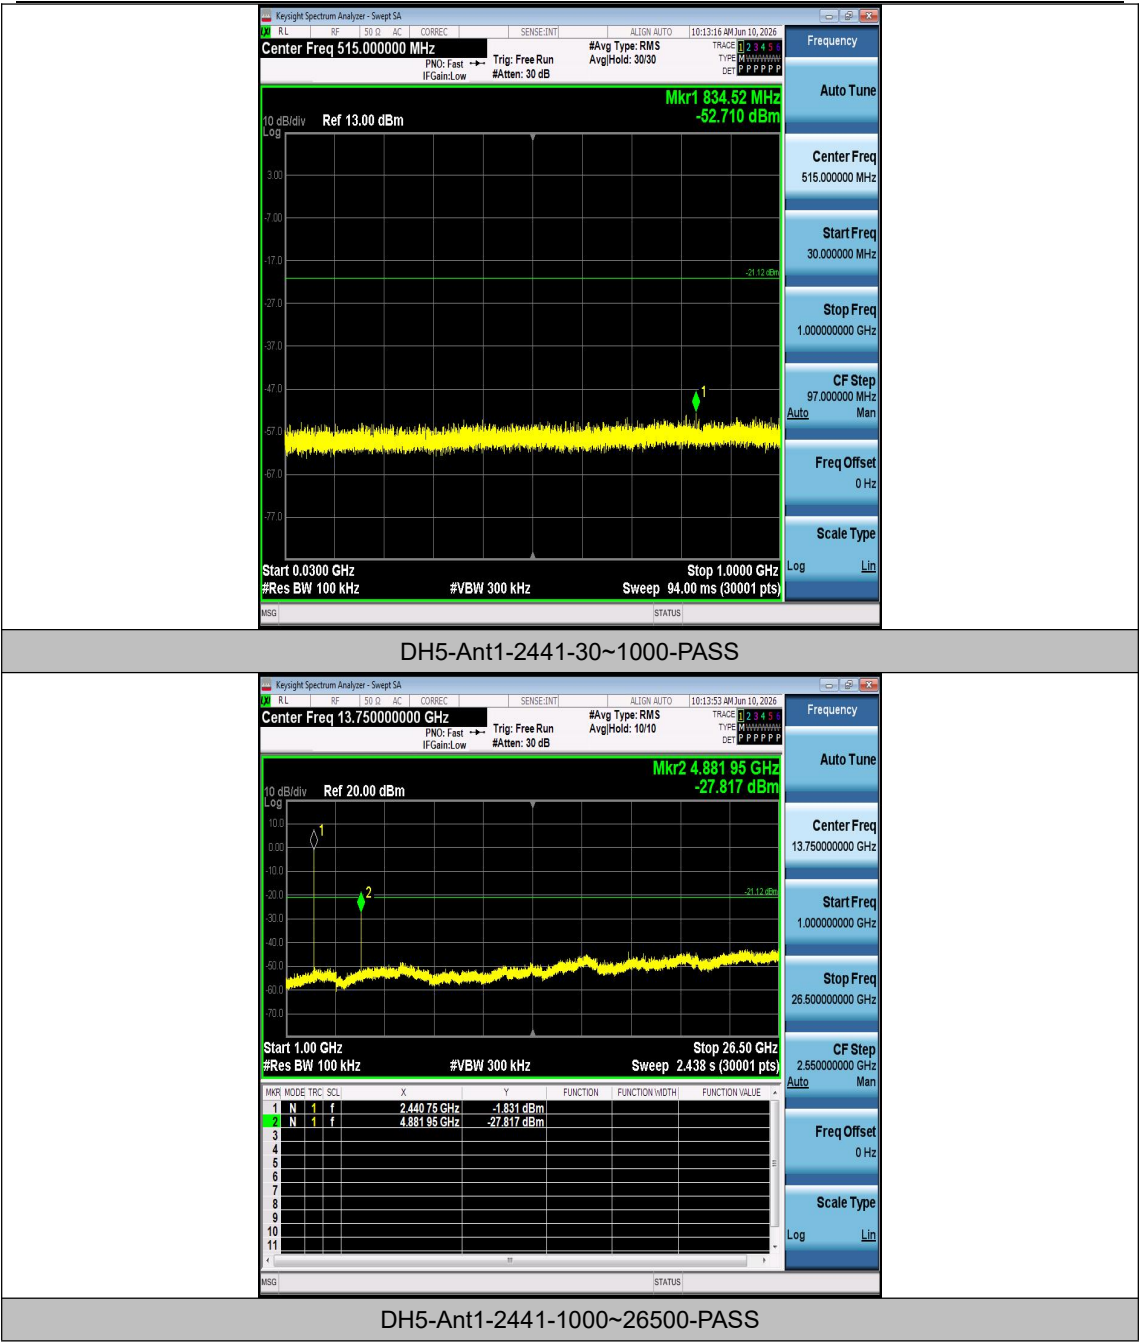

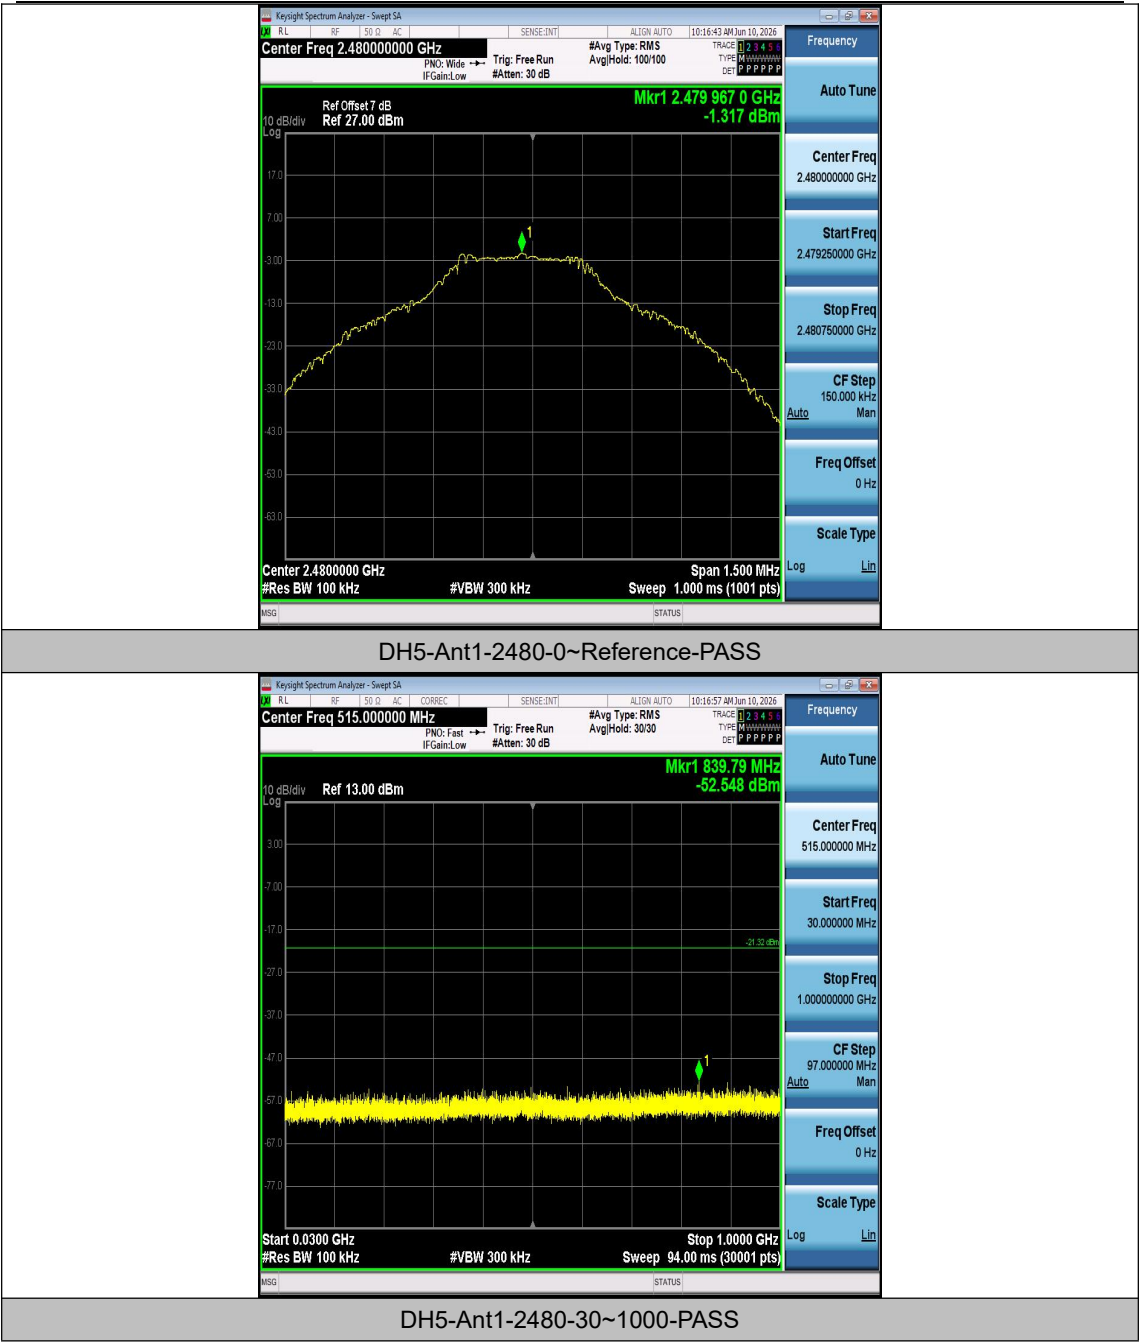

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

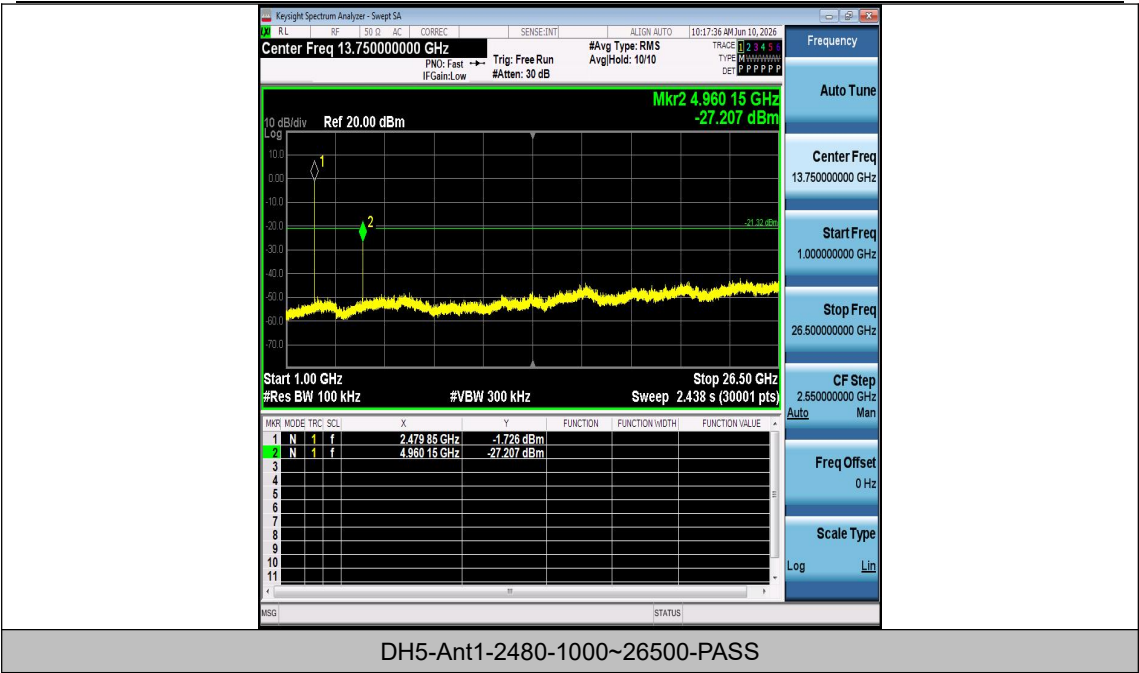

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Appendix I: Duty Cycle

Test Result

Test Mode	Antenna	Frequency[MHz]	ON Time [ms]	Period [ms]	Duty Cycle [%]	Duty Cycle Factor[dB]
DH5	Ant1	2402	2.92	3.75	77.87	1.09
DH5	Ant1	2441	2.91	3.75	77.60	1.10
DH5	Ant1	2480	2.91	3.75	77.60	1.10

Test Graphs



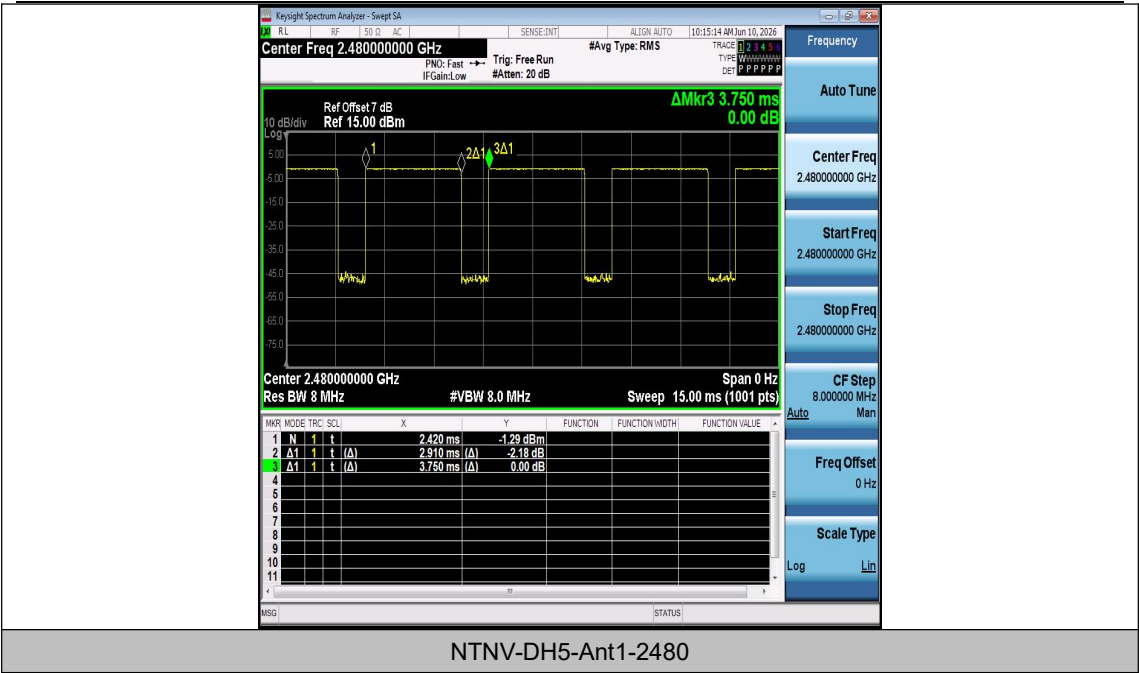

---End---