


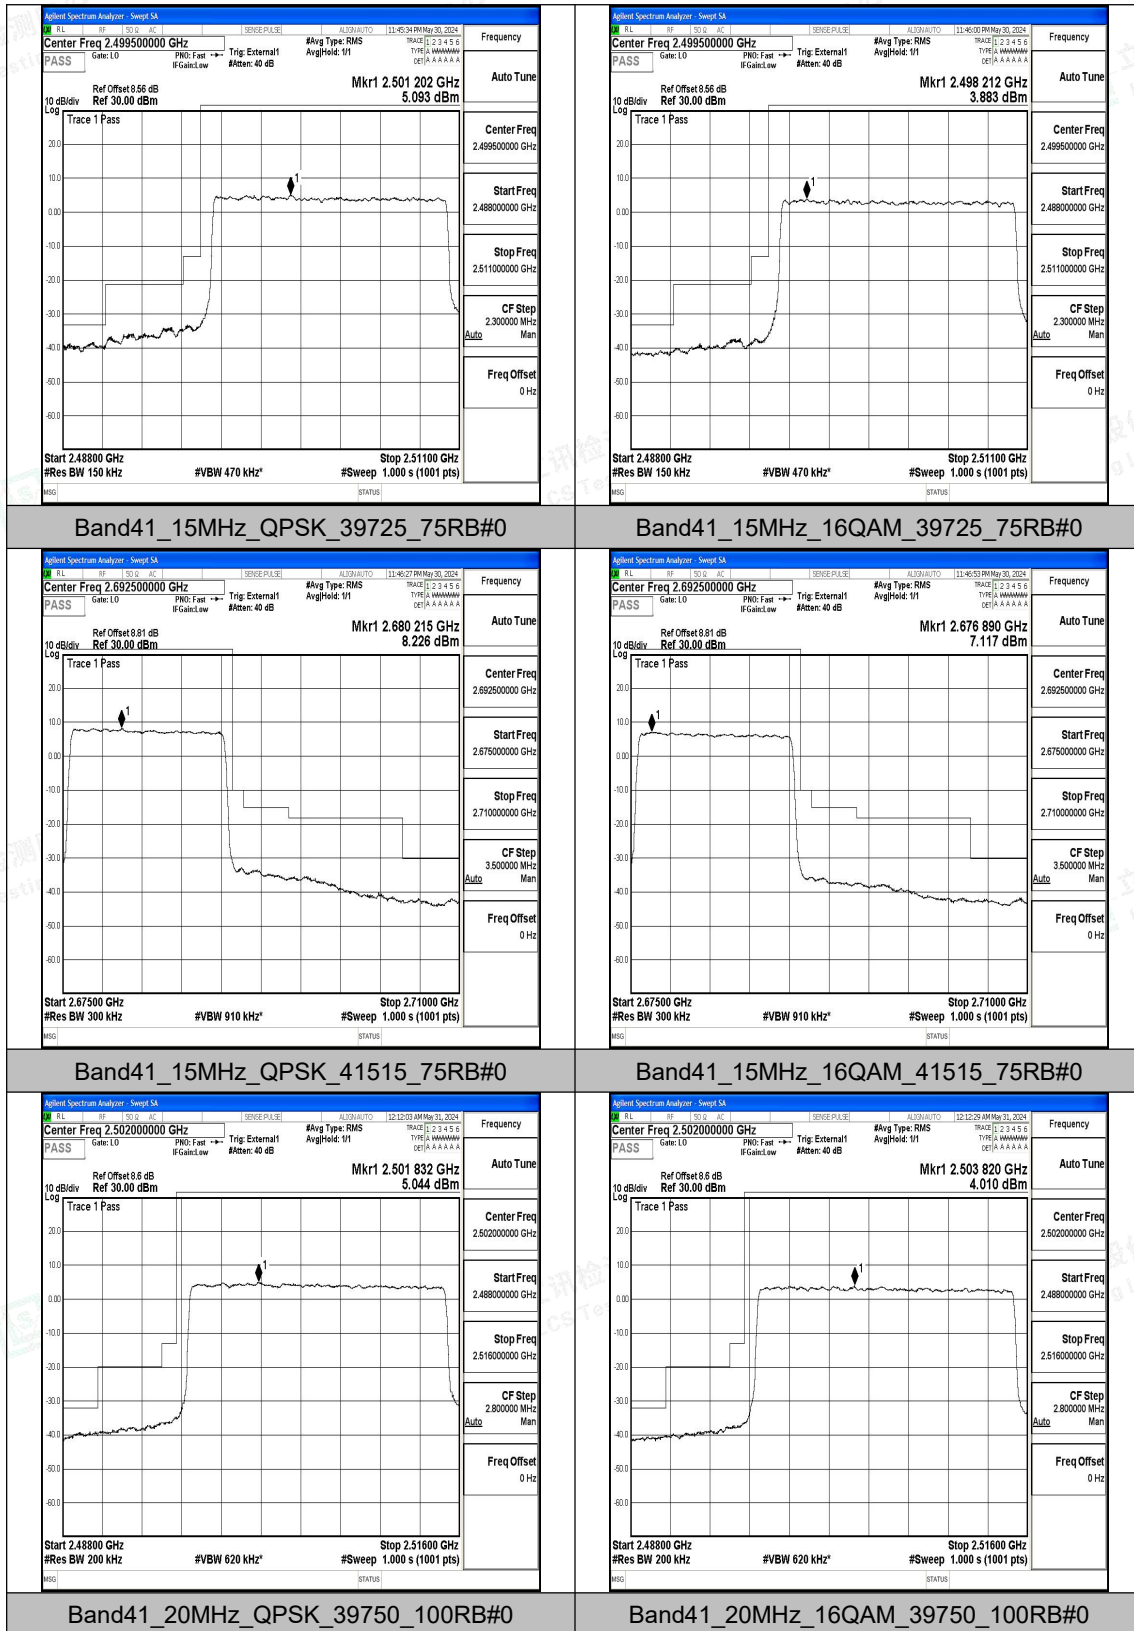


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

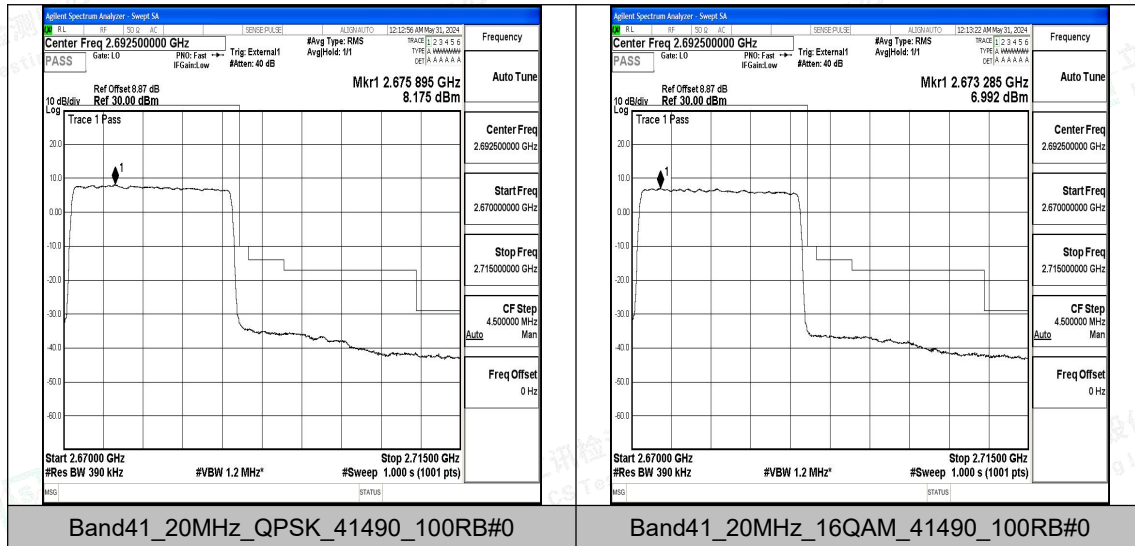



I.5 Conducted Spurious Emission

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Frequency Range	Result (dBm)	Verdict
Band41	5MHz	QPSK	39675	1RB#0	0.009~0.15	-66.53	PASS
Band41	5MHz	QPSK	39675	1RB#0	0.15~30	-61.35	PASS
Band41	5MHz	QPSK	39675	1RB#0	30~1000	-61.98	PASS
Band41	5MHz	QPSK	39675	1RB#0	1000~20000	-32.83	PASS
Band41	5MHz	QPSK	39675	1RB#0	20000~27000	-35.10	PASS
Band41	5MHz	16QAM	39675	1RB#0	0.009~0.15	-65.97	PASS
Band41	5MHz	16QAM	39675	1RB#0	0.15~30	-61.30	PASS
Band41	5MHz	16QAM	39675	1RB#0	30~1000	-61.76	PASS
Band41	5MHz	16QAM	39675	1RB#0	1000~20000	-33.18	PASS
Band41	5MHz	16QAM	39675	1RB#0	20000~27000	-35.19	PASS
Band41	5MHz	QPSK	40620	1RB#0	0.009~0.15	-67.45	PASS
Band41	5MHz	QPSK	40620	1RB#0	0.15~30	-59.50	PASS
Band41	5MHz	QPSK	40620	1RB#0	30~1000	-61.50	PASS
Band41	5MHz	QPSK	40620	1RB#0	1000~20000	-32.56	PASS
Band41	5MHz	QPSK	40620	1RB#0	20000~27000	-34.73	PASS
Band41	5MHz	16QAM	40620	1RB#0	0.009~0.15	-67.00	PASS
Band41	5MHz	16QAM	40620	1RB#0	0.15~30	-57.56	PASS
Band41	5MHz	16QAM	40620	1RB#0	30~1000	-62.04	PASS
Band41	5MHz	16QAM	40620	1RB#0	1000~20000	-32.97	PASS
Band41	5MHz	16QAM	40620	1RB#0	20000~27000	-35.04	PASS
Band41	5MHz	QPSK	41565	1RB#0	0.009~0.15	-67.03	PASS
Band41	5MHz	QPSK	41565	1RB#0	0.15~30	-60.79	PASS
Band41	5MHz	QPSK	41565	1RB#0	30~1000	-62.12	PASS
Band41	5MHz	QPSK	41565	1RB#0	1000~20000	-32.55	PASS
Band41	5MHz	QPSK	41565	1RB#0	20000~27000	-35.10	PASS
Band41	5MHz	16QAM	41565	1RB#0	0.009~0.15	-65.95	PASS
Band41	5MHz	16QAM	41565	1RB#0	0.15~30	-61.44	PASS
Band41	5MHz	16QAM	41565	1RB#0	30~1000	-61.95	PASS
Band41	5MHz	16QAM	41565	1RB#0	1000~20000	-33.41	PASS
Band41	5MHz	16QAM	41565	1RB#0	20000~27000	-35.37	PASS
Band41	10MHz	QPSK	39700	1RB#0	0.009~0.15	-65.53	PASS
Band41	10MHz	QPSK	39700	1RB#0	0.15~30	-59.56	PASS
Band41	10MHz	QPSK	39700	1RB#0	30~1000	-62.28	PASS
Band41	10MHz	QPSK	39700	1RB#0	1000~20000	-33.17	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	10MHz	QPSK	39700	1RB#0	20000~27000	-34.97	PASS
Band41	10MHz	16QAM	39700	1RB#0	0.009~0.15	-68.21	PASS
Band41	10MHz	16QAM	39700	1RB#0	0.15~30	-57.03	PASS
Band41	10MHz	16QAM	39700	1RB#0	30~1000	-62.03	PASS
Band41	10MHz	16QAM	39700	1RB#0	1000~20000	-33.23	PASS
Band41	10MHz	16QAM	39700	1RB#0	20000~27000	-34.99	PASS
Band41	10MHz	QPSK	40620	1RB#0	0.009~0.15	-66.47	PASS
Band41	10MHz	QPSK	40620	1RB#0	0.15~30	-60.36	PASS
Band41	10MHz	QPSK	40620	1RB#0	30~1000	-62.16	PASS
Band41	10MHz	QPSK	40620	1RB#0	1000~20000	-33.21	PASS
Band41	10MHz	QPSK	40620	1RB#0	20000~27000	-35.21	PASS
Band41	10MHz	16QAM	40620	1RB#0	0.009~0.15	-68.66	PASS
Band41	10MHz	16QAM	40620	1RB#0	0.15~30	-62.35	PASS
Band41	10MHz	16QAM	40620	1RB#0	30~1000	-62.18	PASS
Band41	10MHz	16QAM	40620	1RB#0	1000~20000	-33.08	PASS
Band41	10MHz	16QAM	40620	1RB#0	20000~27000	-35.15	PASS
Band41	10MHz	QPSK	41540	1RB#0	0.009~0.15	-64.31	PASS
Band41	10MHz	QPSK	41540	1RB#0	0.15~30	-59.67	PASS
Band41	10MHz	QPSK	41540	1RB#0	30~1000	-61.65	PASS
Band41	10MHz	QPSK	41540	1RB#0	1000~20000	-33.25	PASS
Band41	10MHz	QPSK	41540	1RB#0	20000~27000	-35.04	PASS
Band41	10MHz	16QAM	41540	1RB#0	0.009~0.15	-67.76	PASS
Band41	10MHz	16QAM	41540	1RB#0	0.15~30	-59.94	PASS
Band41	10MHz	16QAM	41540	1RB#0	30~1000	-62.07	PASS
Band41	10MHz	16QAM	41540	1RB#0	1000~20000	-33.25	PASS
Band41	10MHz	16QAM	41540	1RB#0	20000~27000	-34.94	PASS
Band41	15MHz	QPSK	39725	1RB#0	0.009~0.15	-66.94	PASS
Band41	15MHz	QPSK	39725	1RB#0	0.15~30	-57.71	PASS
Band41	15MHz	QPSK	39725	1RB#0	30~1000	-62.24	PASS
Band41	15MHz	QPSK	39725	1RB#0	1000~20000	-33.10	PASS
Band41	15MHz	QPSK	39725	1RB#0	20000~27000	-35.48	PASS
Band41	15MHz	16QAM	39725	1RB#0	0.009~0.15	-63.84	PASS
Band41	15MHz	16QAM	39725	1RB#0	0.15~30	-60.75	PASS
Band41	15MHz	16QAM	39725	1RB#0	30~1000	-62.20	PASS
Band41	15MHz	16QAM	39725	1RB#0	1000~20000	-32.94	PASS
Band41	15MHz	16QAM	39725	1RB#0	20000~27000	-34.92	PASS
Band41	15MHz	QPSK	40620	1RB#0	0.009~0.15	-67.58	PASS
Band41	15MHz	QPSK	40620	1RB#0	0.15~30	-61.31	PASS
Band41	15MHz	QPSK	40620	1RB#0	30~1000	-62.22	PASS
Band41	15MHz	QPSK	40620	1RB#0	1000~20000	-33.10	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	15MHz	QPSK	40620	1RB#0	20000~27000	-35.25	PASS
Band41	15MHz	16QAM	40620	1RB#0	0.009~0.15	-66.19	PASS
Band41	15MHz	16QAM	40620	1RB#0	0.15~30	-58.61	PASS
Band41	15MHz	16QAM	40620	1RB#0	30~1000	-61.79	PASS
Band41	15MHz	16QAM	40620	1RB#0	1000~20000	-33.18	PASS
Band41	15MHz	16QAM	40620	1RB#0	20000~27000	-35.23	PASS
Band41	15MHz	QPSK	41515	1RB#0	0.009~0.15	-68.23	PASS
Band41	15MHz	QPSK	41515	1RB#0	0.15~30	-62.99	PASS
Band41	15MHz	QPSK	41515	1RB#0	30~1000	-62.34	PASS
Band41	15MHz	QPSK	41515	1RB#0	1000~20000	-33.26	PASS
Band41	15MHz	QPSK	41515	1RB#0	20000~27000	-35.27	PASS
Band41	15MHz	16QAM	41515	1RB#0	0.009~0.15	-66.37	PASS
Band41	15MHz	16QAM	41515	1RB#0	0.15~30	-59.83	PASS
Band41	15MHz	16QAM	41515	1RB#0	30~1000	-62.24	PASS
Band41	15MHz	16QAM	41515	1RB#0	1000~20000	-33.03	PASS
Band41	15MHz	16QAM	41515	1RB#0	20000~27000	-34.99	PASS
Band41	20MHz	QPSK	39750	1RB#0	0.009~0.15	-66.77	PASS
Band41	20MHz	QPSK	39750	1RB#0	0.15~30	-61.45	PASS
Band41	20MHz	QPSK	39750	1RB#0	30~1000	-61.99	PASS
Band41	20MHz	QPSK	39750	1RB#0	1000~20000	-33.03	PASS
Band41	20MHz	QPSK	39750	1RB#0	20000~27000	-35.30	PASS
Band41	20MHz	16QAM	39750	1RB#0	0.009~0.15	-68.54	PASS
Band41	20MHz	16QAM	39750	1RB#0	0.15~30	-61.98	PASS
Band41	20MHz	16QAM	39750	1RB#0	30~1000	-62.35	PASS
Band41	20MHz	16QAM	39750	1RB#0	1000~20000	-32.89	PASS
Band41	20MHz	16QAM	39750	1RB#0	20000~27000	-35.37	PASS
Band41	20MHz	QPSK	40620	1RB#0	0.009~0.15	-68.35	PASS
Band41	20MHz	QPSK	40620	1RB#0	0.15~30	-61.72	PASS
Band41	20MHz	QPSK	40620	1RB#0	30~1000	-62.09	PASS
Band41	20MHz	QPSK	40620	1RB#0	1000~20000	-33.22	PASS
Band41	20MHz	QPSK	40620	1RB#0	20000~27000	-35.14	PASS
Band41	20MHz	16QAM	40620	1RB#0	0.009~0.15	-67.96	PASS
Band41	20MHz	16QAM	40620	1RB#0	0.15~30	-60.62	PASS
Band41	20MHz	16QAM	40620	1RB#0	30~1000	-61.97	PASS
Band41	20MHz	16QAM	40620	1RB#0	1000~20000	-33.28	PASS
Band41	20MHz	16QAM	40620	1RB#0	20000~27000	-35.16	PASS
Band41	20MHz	QPSK	41490	1RB#0	0.009~0.15	-67.10	PASS
Band41	20MHz	QPSK	41490	1RB#0	0.15~30	-59.14	PASS
Band41	20MHz	QPSK	41490	1RB#0	30~1000	-62.10	PASS
Band41	20MHz	QPSK	41490	1RB#0	1000~20000	-33.00	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	20MHz	QPSK	41490	1RB#0	20000~27000	-34.93	PASS
Band41	20MHz	16QAM	41490	1RB#0	0.009~0.15	-65.96	PASS
Band41	20MHz	16QAM	41490	1RB#0	0.15~30	-60.90	PASS
Band41	20MHz	16QAM	41490	1RB#0	30~1000	-62.24	PASS
Band41	20MHz	16QAM	41490	1RB#0	1000~20000	-33.02	PASS
Band41	20MHz	16QAM	41490	1RB#0	20000~27000	-35.41	PASS

Test Graphs

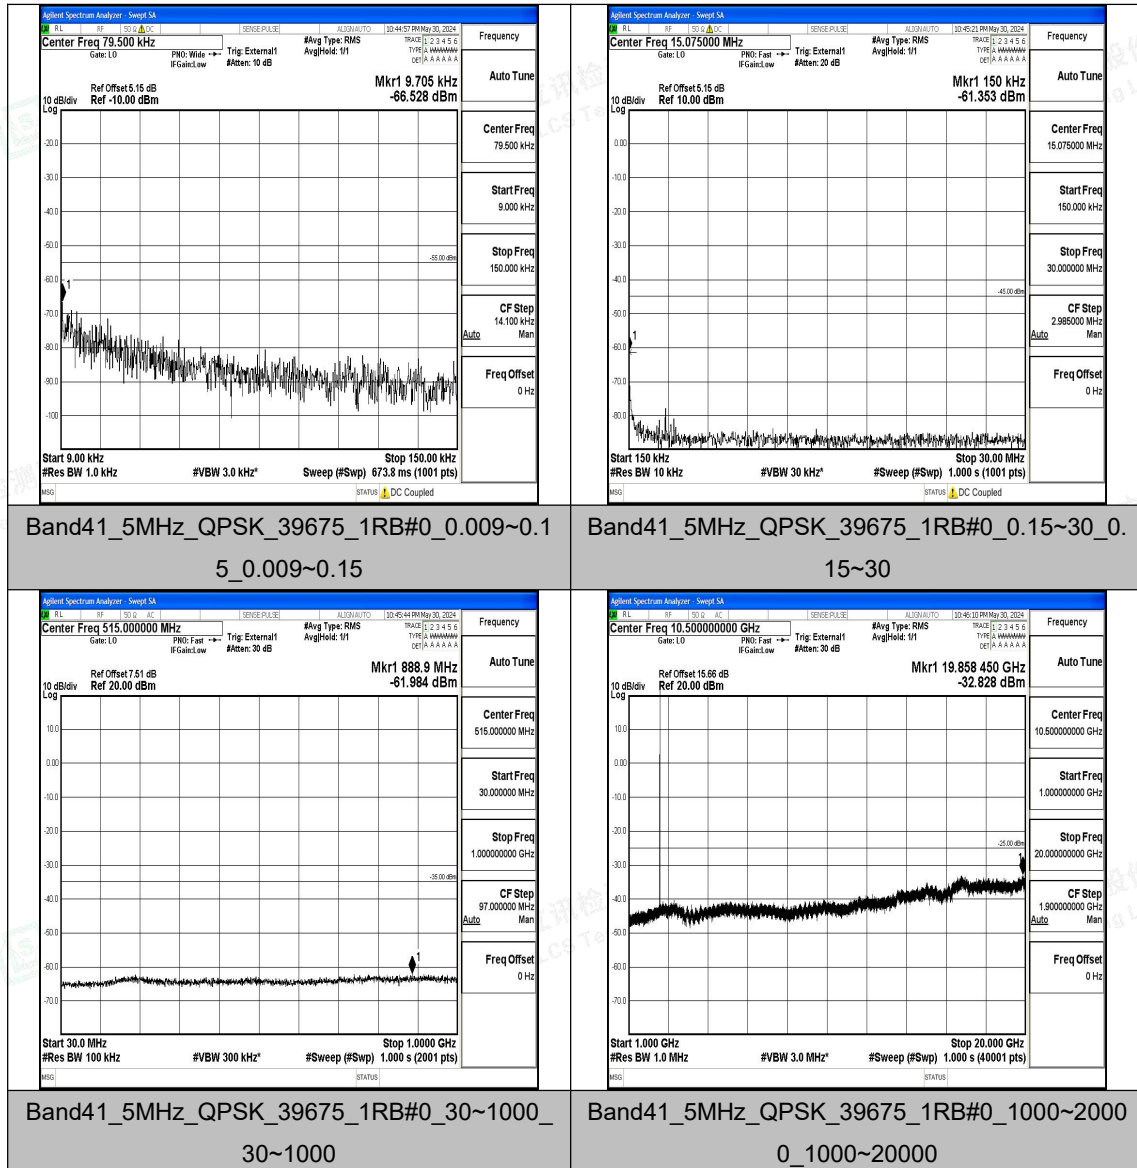


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

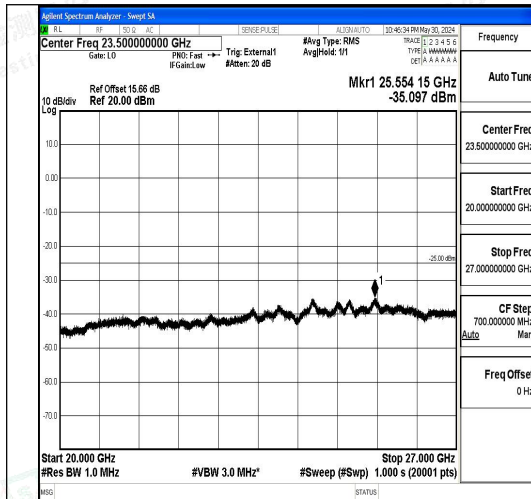


Band41_5MHz_QPSK_39675_1RB#0_20000~27000_20000~27000

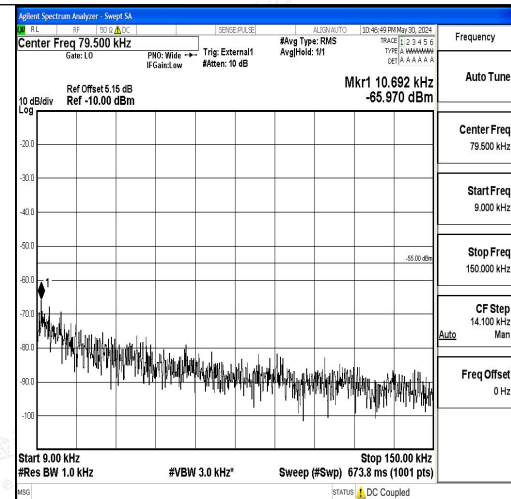


Band41_5MHz_16QAM_39675_1RB#0_0.009~0.1
5_0.009~0.15

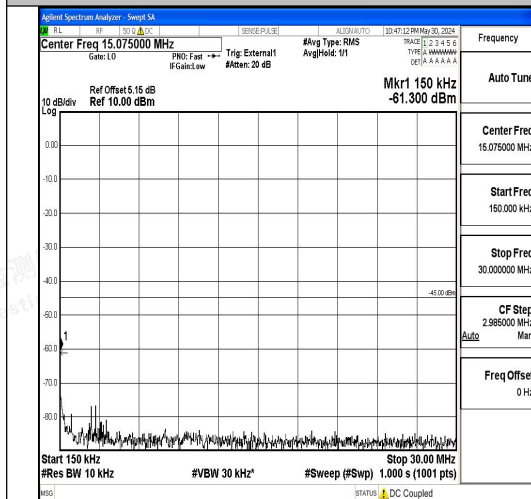


Band41_5MHz_16QAM_39675_1RB#0_0.15~30
0.15~30

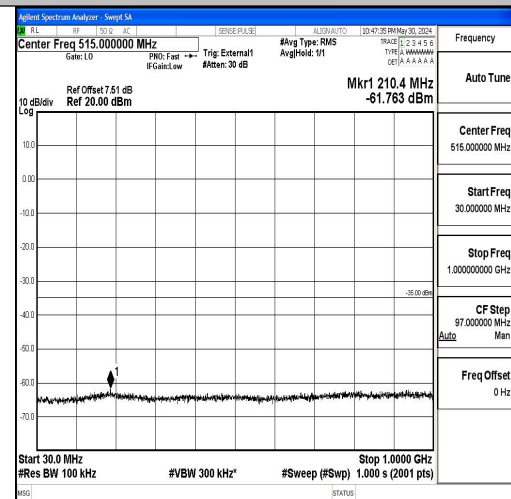

Band41_5MHz_16QAM_39675_1RB#0_30~1000_30~1000

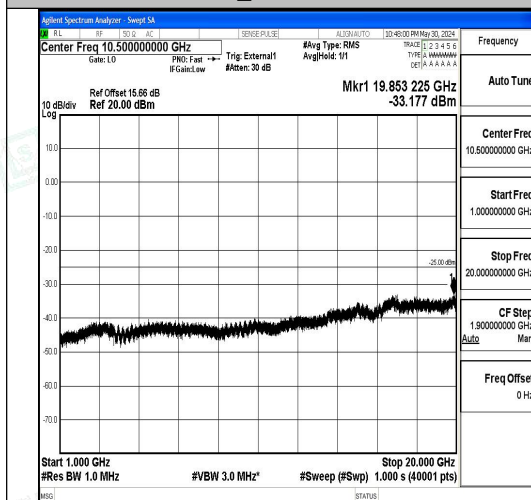


Band41_5MHz_16QAM_39675_1RB#0_1000~20000

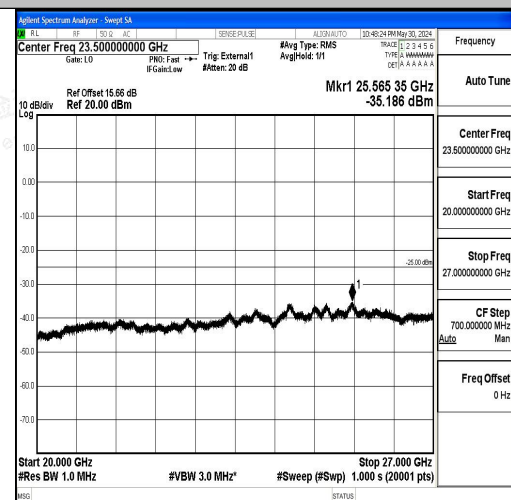


Band41_5MHz_16QAM_39675_1RB#0_20000~27000




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen,
518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

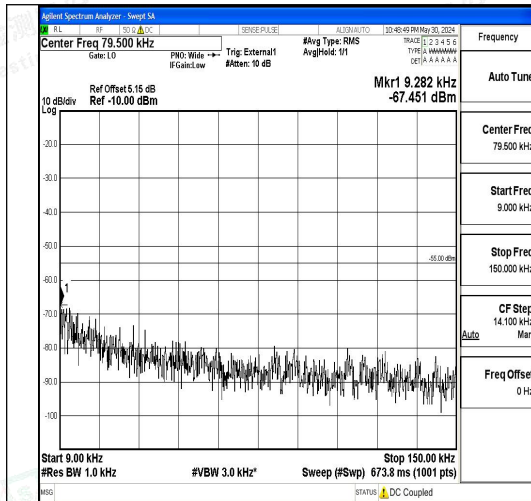


Band41_5MHz_QPSK_40620_1RB#0_0.009~0.15_5_0.009~0.15

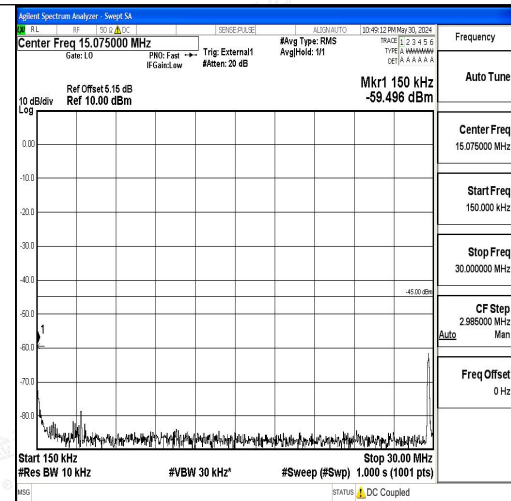


Band41_5MHz_QPSK_40620_1RB#0_0.15~30_0.15~30

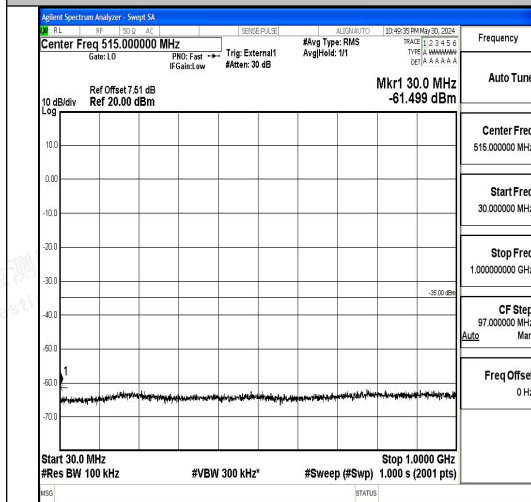


Band41_5MHz_QPSK_40620_1RB#0_30~1000_30~1000

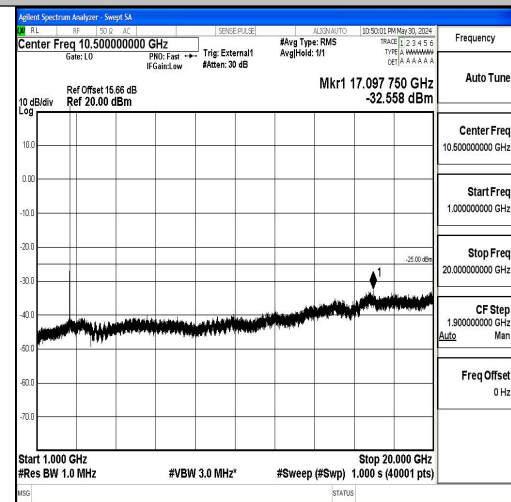

Band41_5MHz_QPSK_40620_1RB#0_1000~2000_0_1000~20000

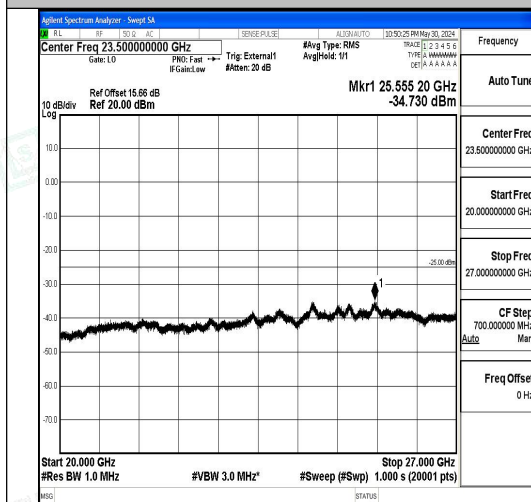


Band41_5MHz_QPSK_40620_1RB#0_20000~27000_000_20000~27000

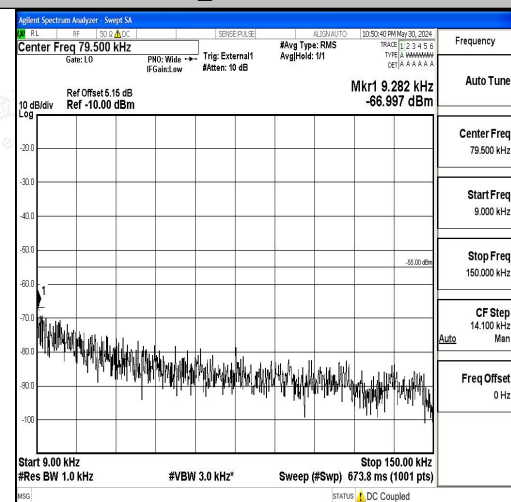


Band41_5MHz_16QAM_40620_1RB#0_0.009~0.15_5_0.009~0.15




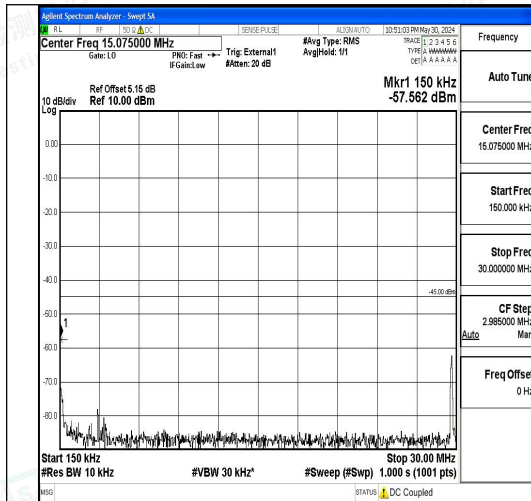


Band41_5MHz_16QAM_40620_1RB#0_0.15~30_0.15~30

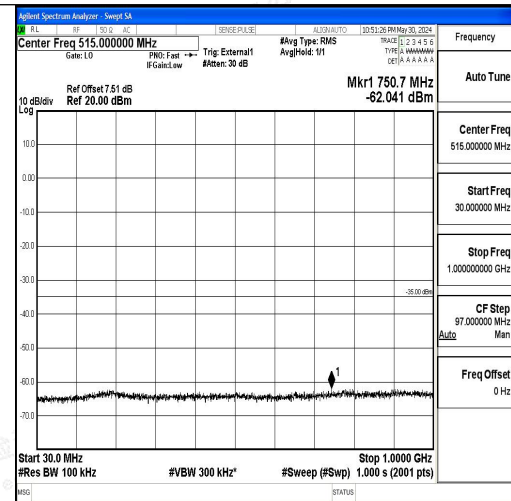


Band41_5MHz_16QAM_40620_1RB#0_30~1000_30~1000

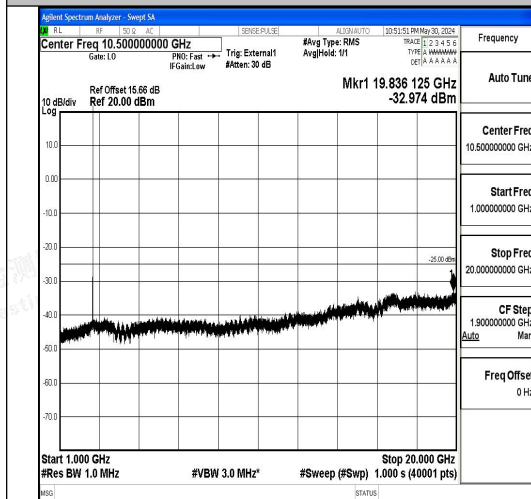


Band41_5MHz_16QAM_40620_1RB#0_1000~20000_1000~20000

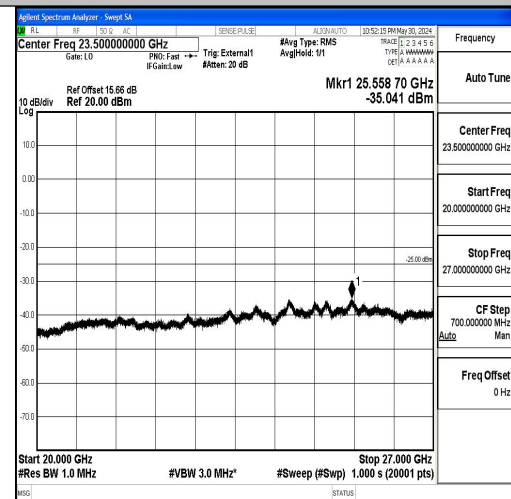

Band41_5MHz_16QAM_40620_1RB#0_20000~27000_000_1000~20000

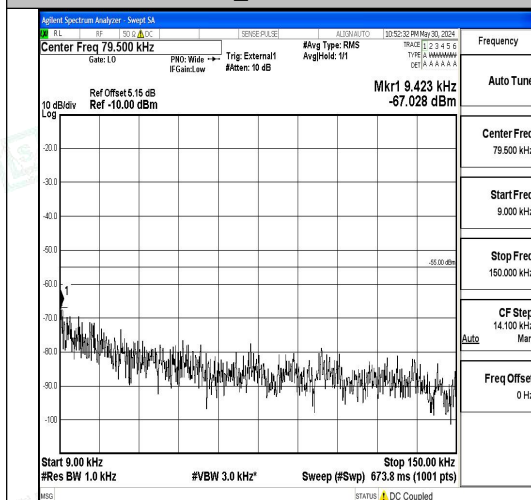

Band41_5MHz_QPSK_41565_1RB#0_0.009~0.1_5_0.009~0.15

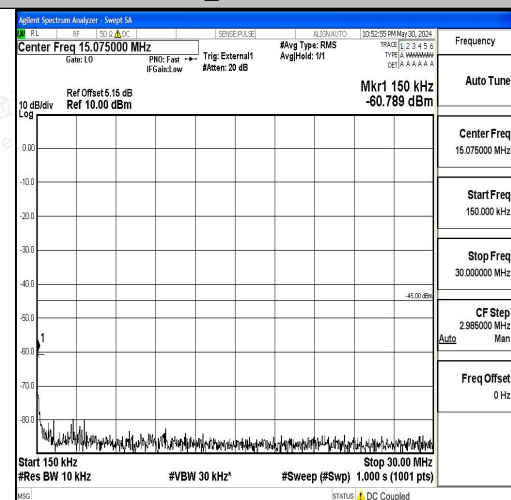

Band41_5MHz_QPSK_41565_1RB#0_0.15~30_0.15~30



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

