

Appendix Test Data

Report No.:	1812C60174912504-01	Test Sample No.:	1-2-2
Start Test Date:	2026-3-30	Finish Test Date:	2026-6-17
Test Engineer:	Pearl Ao	Auditor:	Justin Feng
Temperature:	25°C	Relative Humidity:	45%
Pressure:	101kPa		



Appendix A1: 26dB Bandwidth

Test Result

Test Mode	Antenna	Frequency[MHz]	26db EBW [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5180	23.800	5168.320	5192.120	---	---
11A	Ant2	5180	23.760	5167.920	5191.680	---	---
11A	Ant1	5220	23.480	5208.520	5232.000	---	---
11A	Ant2	5220	22.760	5208.840	5231.600	---	---
11A	Ant1	5240	24.000	5227.880	5251.880	---	---
11A	Ant2	5240	22.120	5229.240	5251.360	---	---
11A	Ant1	5260	23.760	5248.320	5272.080	---	---
11A	Ant2	5260	23.400	5248.720	5272.120	---	---
11A	Ant1	5300	23.400	5288.520	5311.920	---	---
11A	Ant2	5300	22.880	5288.600	5311.480	---	---
11A	Ant1	5320	24.040	5307.680	5331.720	---	---
11A	Ant2	5320	23.720	5307.920	5331.640	---	---
11A	Ant1	5500	22.760	5488.800	5511.560	---	---
11A	Ant2	5500	22.840	5488.560	5511.400	---	---
11A	Ant1	5580	23.760	5568.560	5592.320	---	---
11A	Ant2	5580	23.080	5568.240	5591.320	---	---
11A	Ant1	5700	23.080	5688.560	5711.640	---	---
11A	Ant2	5700	22.800	5688.800	5711.600	---	---
11A	Ant1	5745	24.600	5732.480	5757.080	---	---
11A	Ant2	5745	24.040	5732.680	5756.720	---	---
11A	Ant1	5785	23.800	5773.080	5796.880	---	---
11A	Ant2	5785	23.720	5773.200	5796.920	---	---
11A	Ant1	5825	24.200	5813.040	5837.240	---	---
11A	Ant2	5825	23.920	5813.200	5837.120	---	---

11N20SISO	Ant1	5180	23.400	5168.520	5191.920	---	---
11N20SISO	Ant2	5180	23.800	5168.040	5191.840	---	---
11N20SISO	Ant1	5220	23.920	5207.680	5231.600	---	---
11N20SISO	Ant2	5220	24.240	5208.400	5232.640	---	---
11N20SISO	Ant1	5240	23.320	5228.480	5251.800	---	---
11N20SISO	Ant2	5240	23.720	5228.400	5252.120	---	---
11N20SISO	Ant1	5260	24.240	5248.000	5272.240	---	---
11N20SISO	Ant2	5260	23.640	5248.280	5271.920	---	---
11N20SISO	Ant1	5300	23.200	5288.120	5311.320	---	---
11N20SISO	Ant2	5300	24.080	5288.600	5312.680	---	---
11N20SISO	Ant1	5320	23.320	5308.560	5331.880	---	---
11N20SISO	Ant2	5320	23.160	5308.360	5331.520	---	---
11N20SISO	Ant1	5500	24.560	5487.560	5512.120	---	---
11N20SISO	Ant2	5500	23.240	5488.520	5511.760	---	---
11N20SISO	Ant1	5580	24.000	5568.080	5592.080	---	---
11N20SISO	Ant2	5580	23.920	5567.840	5591.760	---	---
11N20SISO	Ant1	5700	24.880	5687.400	5712.280	---	---
11N20SISO	Ant2	5700	23.480	5688.120	5711.600	---	---
11N20SISO	Ant1	5745	24.480	5732.680	5757.160	---	---
11N20SISO	Ant2	5745	24.920	5732.560	5757.480	---	---
11N20SISO	Ant1	5785	25.160	5772.120	5797.280	---	---
11N20SISO	Ant2	5785	24.440	5772.840	5797.280	---	---
11N20SISO	Ant1	5825	24.560	5812.600	5837.160	---	---
11N20SISO	Ant2	5825	24.240	5812.960	5837.200	---	---
11N40SISO	Ant1	5190	43.520	5168.560	5212.080	---	---
11N40SISO	Ant2	5190	42.080	5169.280	5211.360	---	---
11N40SISO	Ant1	5230	43.520	5208.400	5251.920	---	---
11N40SISO	Ant2	5230	43.360	5208.400	5251.760	---	---
11N40SISO	Ant1	5270	43.440	5248.080	5291.520	---	---
11N40SISO	Ant2	5270	43.040	5248.960	5292.000	---	---
11N40SISO	Ant1	5310	42.320	5288.800	5331.120	---	---
11N40SISO	Ant2	5310	43.520	5288.320	5331.840	---	---
11N40SISO	Ant1	5510	42.240	5488.640	5530.880	---	---
11N40SISO	Ant2	5510	43.440	5488.480	5531.920	---	---
11N40SISO	Ant1	5550	42.480	5528.880	5571.360	---	---
11N40SISO	Ant2	5550	43.360	5528.880	5572.240	---	---
11N40SISO	Ant1	5670	42.720	5648.960	5691.680	---	---
11N40SISO	Ant2	5670	43.280	5648.400	5691.680	---	---
11N40SISO	Ant1	5755	44.640	5733.160	5777.800	---	---
11N40SISO	Ant2	5755	43.760	5733.240	5777.000	---	---
11N40SISO	Ant1	5795	43.200	5773.400	5816.600	---	---
11N40SISO	Ant2	5795	43.520	5772.760	5816.280	---	---

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

11AC20SISO	Ant1	5180	23.840	5168.320	5192.160	---	---
11AC20SISO	Ant2	5180	24.760	5167.760	5192.520	---	---
11AC20SISO	Ant1	5220	23.760	5207.840	5231.600	---	---
11AC20SISO	Ant2	5220	23.520	5208.360	5231.880	---	---
11AC20SISO	Ant1	5240	23.760	5228.280	5252.040	---	---
11AC20SISO	Ant2	5240	24.040	5227.800	5251.840	---	---
11AC20SISO	Ant1	5260	23.080	5248.360	5271.440	---	---
11AC20SISO	Ant2	5260	23.640	5248.120	5271.760	---	---
11AC20SISO	Ant1	5300	24.280	5287.960	5312.240	---	---
11AC20SISO	Ant2	5300	23.520	5288.160	5311.680	---	---
11AC20SISO	Ant1	5320	23.800	5307.920	5331.720	---	---
11AC20SISO	Ant2	5320	23.360	5308.600	5331.960	---	---
11AC20SISO	Ant1	5500	23.400	5488.000	5511.400	---	---
11AC20SISO	Ant2	5500	23.640	5488.400	5512.040	---	---
11AC20SISO	Ant1	5580	23.120	5568.640	5591.760	---	---
11AC20SISO	Ant2	5580	23.120	5568.320	5591.440	---	---
11AC20SISO	Ant1	5700	24.040	5687.600	5711.640	---	---
11AC20SISO	Ant2	5700	23.760	5687.760	5711.520	---	---
11AC20SISO	Ant1	5745	24.320	5732.960	5757.280	---	---
11AC20SISO	Ant2	5745	24.000	5733.200	5757.200	---	---
11AC20SISO	Ant1	5785	24.720	5772.560	5797.280	---	---
11AC20SISO	Ant2	5785	24.840	5772.800	5797.640	---	---
11AC20SISO	Ant1	5825	24.400	5812.640	5837.040	---	---
11AC20SISO	Ant2	5825	24.080	5812.560	5836.640	---	---
11AC40SISO	Ant1	5190	43.280	5168.400	5211.680	---	---
11AC40SISO	Ant2	5190	43.600	5168.560	5212.160	---	---
11AC40SISO	Ant1	5230	43.040	5208.400	5251.440	---	---
11AC40SISO	Ant2	5230	42.720	5209.200	5251.920	---	---
11AC40SISO	Ant1	5270	43.440	5248.480	5291.920	---	---
11AC40SISO	Ant2	5270	43.600	5248.400	5292.000	---	---
11AC40SISO	Ant1	5310	42.480	5288.720	5331.200	---	---
11AC40SISO	Ant2	5310	43.600	5288.240	5331.840	---	---
11AC40SISO	Ant1	5510	43.360	5488.800	5532.160	---	---
11AC40SISO	Ant2	5510	43.600	5488.880	5532.480	---	---
11AC40SISO	Ant1	5550	42.400	5528.640	5571.040	---	---
11AC40SISO	Ant2	5550	44.160	5528.560	5572.720	---	---
11AC40SISO	Ant1	5670	43.920	5648.000	5691.920	---	---
11AC40SISO	Ant2	5670	44.160	5648.560	5692.720	---	---
11AC40SISO	Ant1	5755	44.320	5733.080	5777.400	---	---
11AC40SISO	Ant2	5755	44.960	5733.320	5778.280	---	---
11AC40SISO	Ant1	5795	44.080	5772.680	5816.760	---	---
11AC40SISO	Ant2	5795	44.880	5773.240	5818.120	---	---

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

11AC80SISO	Ant1	5210	84.000	5168.240	5252.240	---	---
11AC80SISO	Ant2	5210	84.000	5168.080	5252.080	---	---
11AC80SISO	Ant1	5290	83.040	5248.240	5331.280	---	---
11AC80SISO	Ant2	5290	83.680	5248.720	5332.400	---	---
11AC80SISO	Ant1	5530	84.160	5487.920	5572.080	---	---
11AC80SISO	Ant2	5530	84.000	5488.560	5572.560	---	---
11AC80SISO	Ant1	5775	84.160	5733.400	5817.560	---	---
11AC80SISO	Ant2	5775	84.480	5732.760	5817.240	---	---
11AC80SISO	Ant1	5610	83.680	5568.560	5652.240	---	---
11AC80SISO	Ant2	5610	84.000	5568.880	5652.880	---	---
11AX20SISO	Ant1	5180	22.080	5169.160	5191.240	---	---
11AX20SISO	Ant2	5180	23.120	5168.560	5191.680	---	---
11AX20SISO	Ant1	5220	22.760	5208.840	5231.600	---	---
11AX20SISO	Ant2	5220	22.520	5208.840	5231.360	---	---
11AX20SISO	Ant1	5240	23.400	5228.560	5251.960	---	---
11AX20SISO	Ant2	5240	23.280	5228.520	5251.800	---	---
11AX20SISO	Ant1	5260	23.040	5248.560	5271.600	---	---
11AX20SISO	Ant2	5260	23.040	5248.600	5271.640	---	---
11AX20SISO	Ant1	5300	24.000	5287.640	5311.640	---	---
11AX20SISO	Ant2	5300	22.240	5288.920	5311.160	---	---
11AX20SISO	Ant1	5320	22.680	5308.480	5331.160	---	---
11AX20SISO	Ant2	5320	22.520	5309.120	5331.640	---	---
11AX20SISO	Ant1	5500	22.720	5488.640	5511.360	---	---
11AX20SISO	Ant2	5500	23.440	5488.240	5511.680	---	---
11AX20SISO	Ant1	5580	23.360	5568.720	5592.080	---	---
11AX20SISO	Ant2	5580	22.800	5568.600	5591.400	---	---
11AX20SISO	Ant1	5700	22.280	5688.920	5711.200	---	---
11AX20SISO	Ant2	5700	23.120	5688.360	5711.480	---	---
11AX20SISO	Ant1	5745	24.640	5733.240	5757.880	---	---
11AX20SISO	Ant2	5745	23.680	5733.200	5756.880	---	---
11AX20SISO	Ant1	5785	23.880	5773.120	5797.000	---	---
11AX20SISO	Ant2	5785	24.120	5772.880	5797.000	---	---
11AX20SISO	Ant1	5825	24.200	5812.640	5836.840	---	---
11AX20SISO	Ant2	5825	23.760	5813.280	5837.040	---	---
11AX40SISO	Ant1	5190	44.480	5168.240	5212.720	---	---
11AX40SISO	Ant2	5190	42.240	5168.800	5211.040	---	---
11AX40SISO	Ant1	5230	42.640	5208.720	5251.360	---	---
11AX40SISO	Ant2	5230	42.000	5209.200	5251.200	---	---
11AX40SISO	Ant1	5270	41.200	5249.520	5290.720	---	---
11AX40SISO	Ant2	5270	42.640	5248.960	5291.600	---	---
11AX40SISO	Ant1	5310	41.680	5289.040	5330.720	---	---
11AX40SISO	Ant2	5310	43.200	5288.640	5331.840	---	---

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


11AX40SISO	Ant1	5510	42.480	5488.800	5531.280	---	---
11AX40SISO	Ant2	5510	41.360	5489.360	5530.720	---	---
11AX40SISO	Ant1	5550	43.040	5529.120	5572.160	---	---
11AX40SISO	Ant2	5550	41.840	5529.200	5571.040	---	---
11AX40SISO	Ant1	5670	42.320	5648.720	5691.040	---	---
11AX40SISO	Ant2	5670	41.440	5649.200	5690.640	---	---
11AX40SISO	Ant1	5755	43.840	5733.320	5777.160	---	---
11AX40SISO	Ant2	5755	42.480	5733.320	5775.800	---	---
11AX40SISO	Ant1	5795	43.200	5773.880	5817.080	---	---
11AX40SISO	Ant2	5795	44.240	5773.400	5817.640	---	---
11AX80SISO	Ant1	5210	85.280	5166.960	5252.240	---	---
11AX80SISO	Ant2	5210	84.160	5168.240	5252.400	---	---
11AX80SISO	Ant1	5290	83.840	5248.400	5332.240	---	---
11AX80SISO	Ant2	5290	83.840	5247.920	5331.760	---	---
11AX80SISO	Ant1	5530	84.160	5488.720	5572.880	---	---
11AX80SISO	Ant2	5530	84.160	5488.240	5572.400	---	---
11AX80SISO	Ant1	5775	84.160	5732.920	5817.080	---	---
11AX80SISO	Ant2	5775	83.520	5732.760	5816.280	---	---
11AX80SISO	Ant1	5610	83.840	5568.400	5652.240	---	---
11AX80SISO	Ant2	5610	83.840	5568.400	5652.240	---	---

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Test Graphs

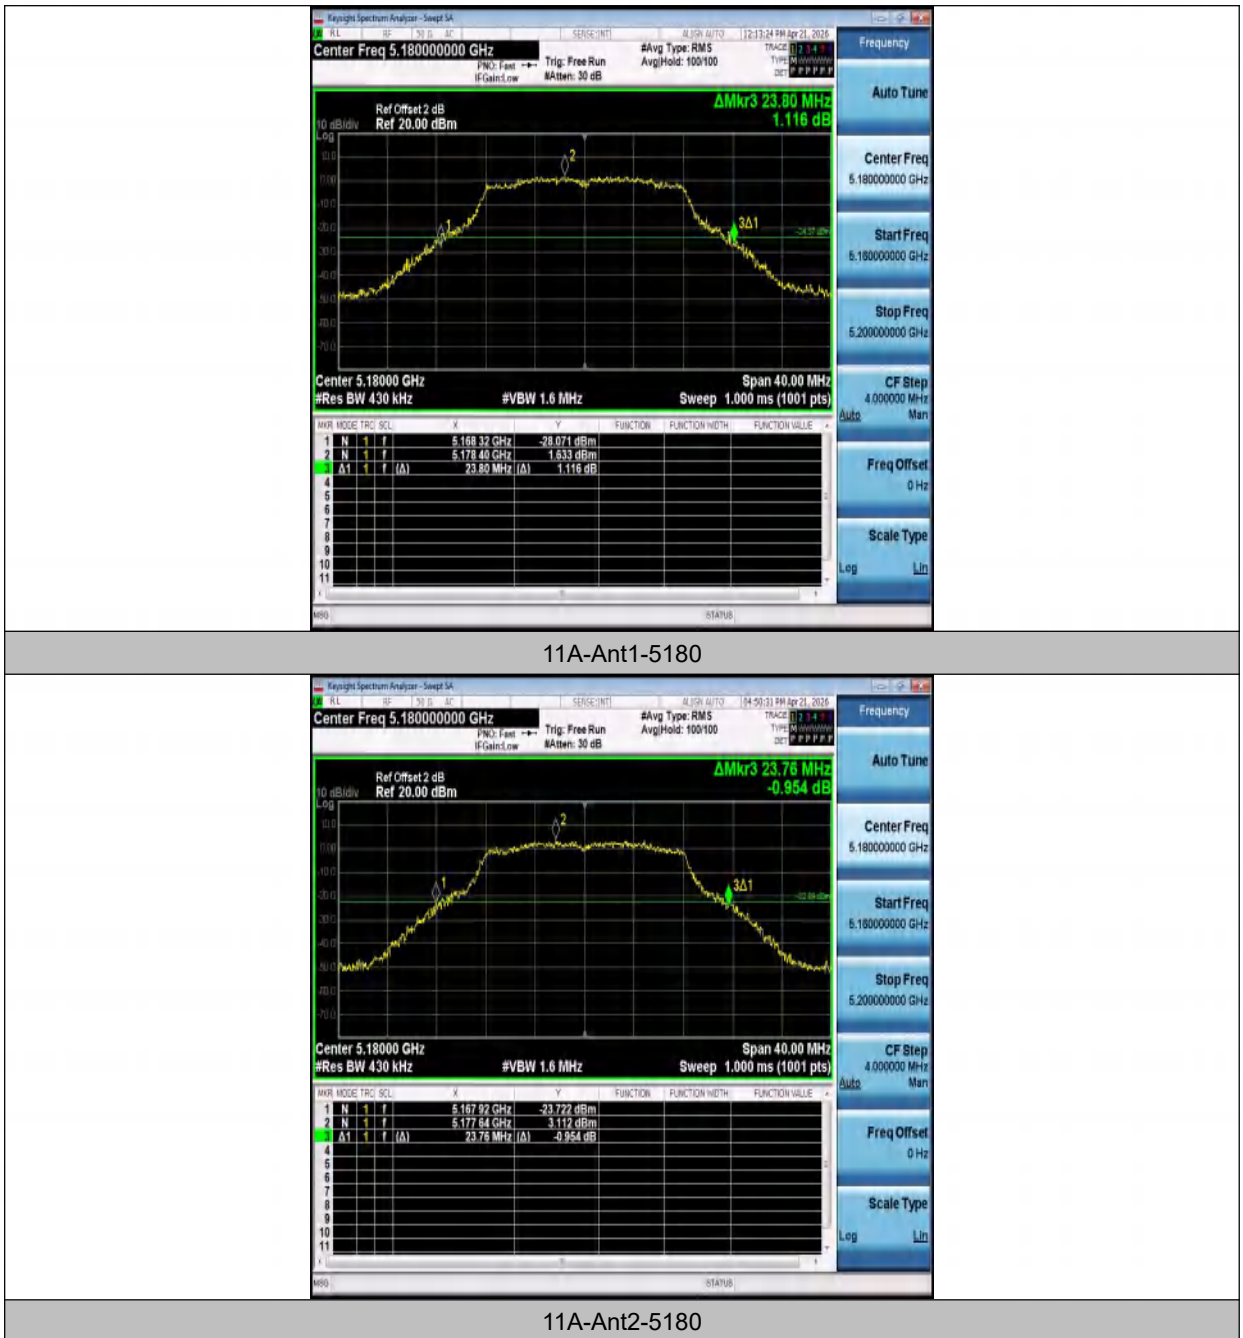

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

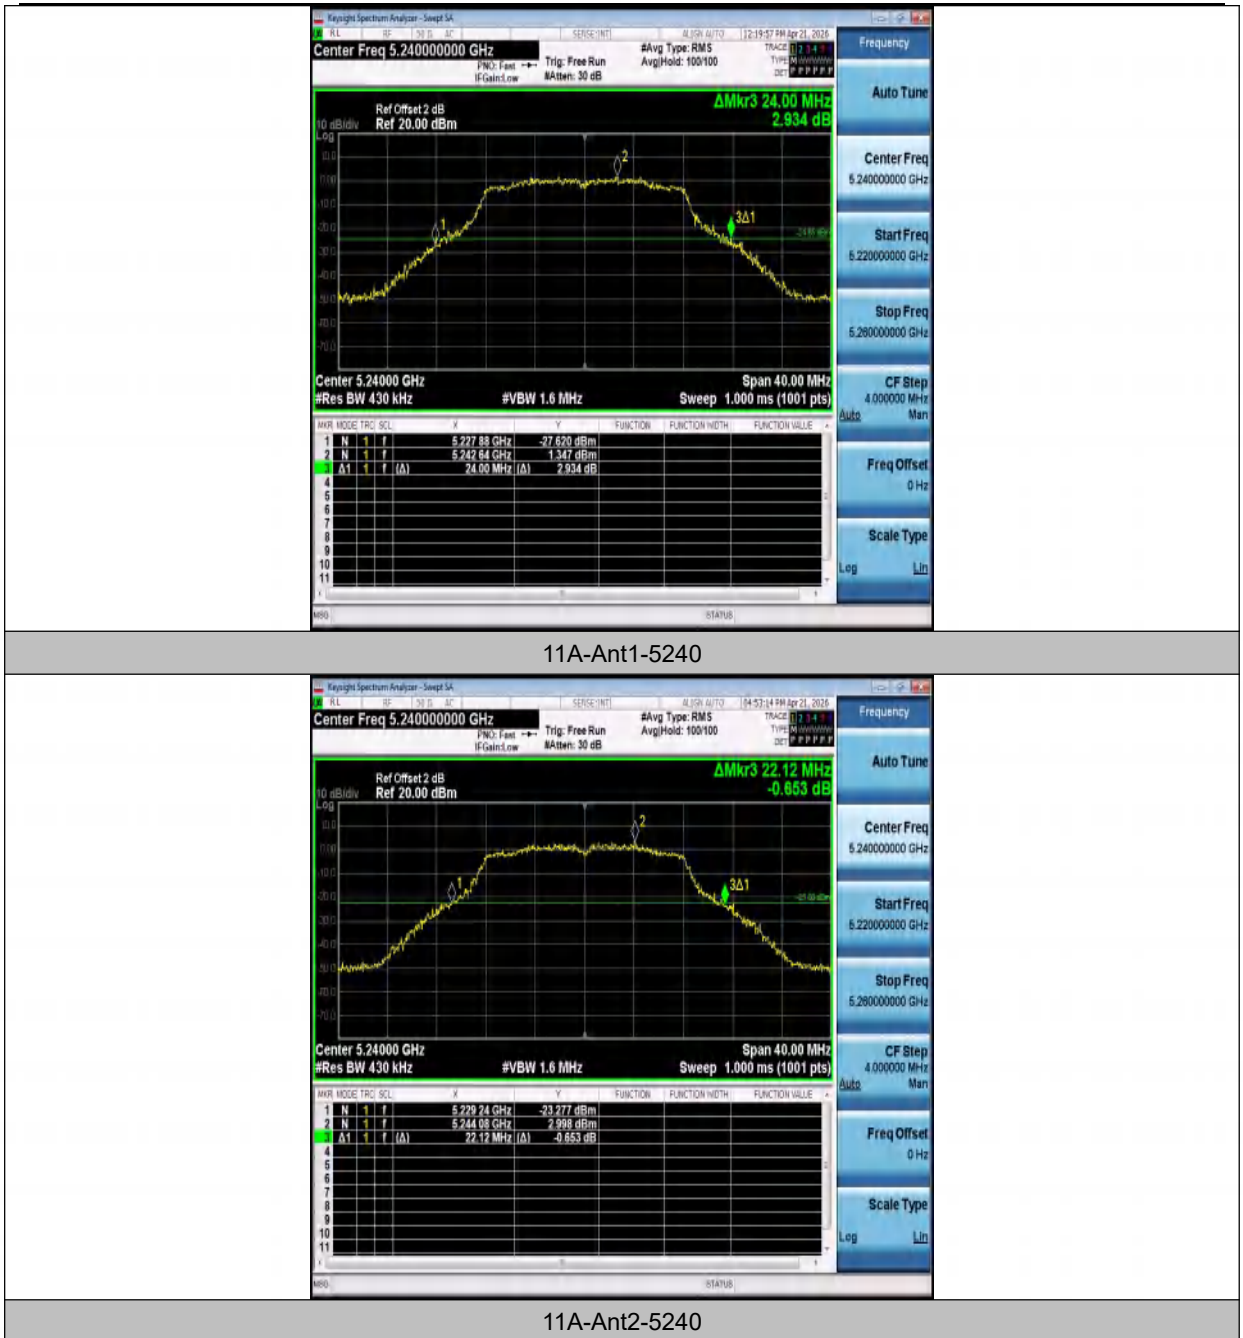

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



11A-Ant1-5260




11A-Ant2-5260


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



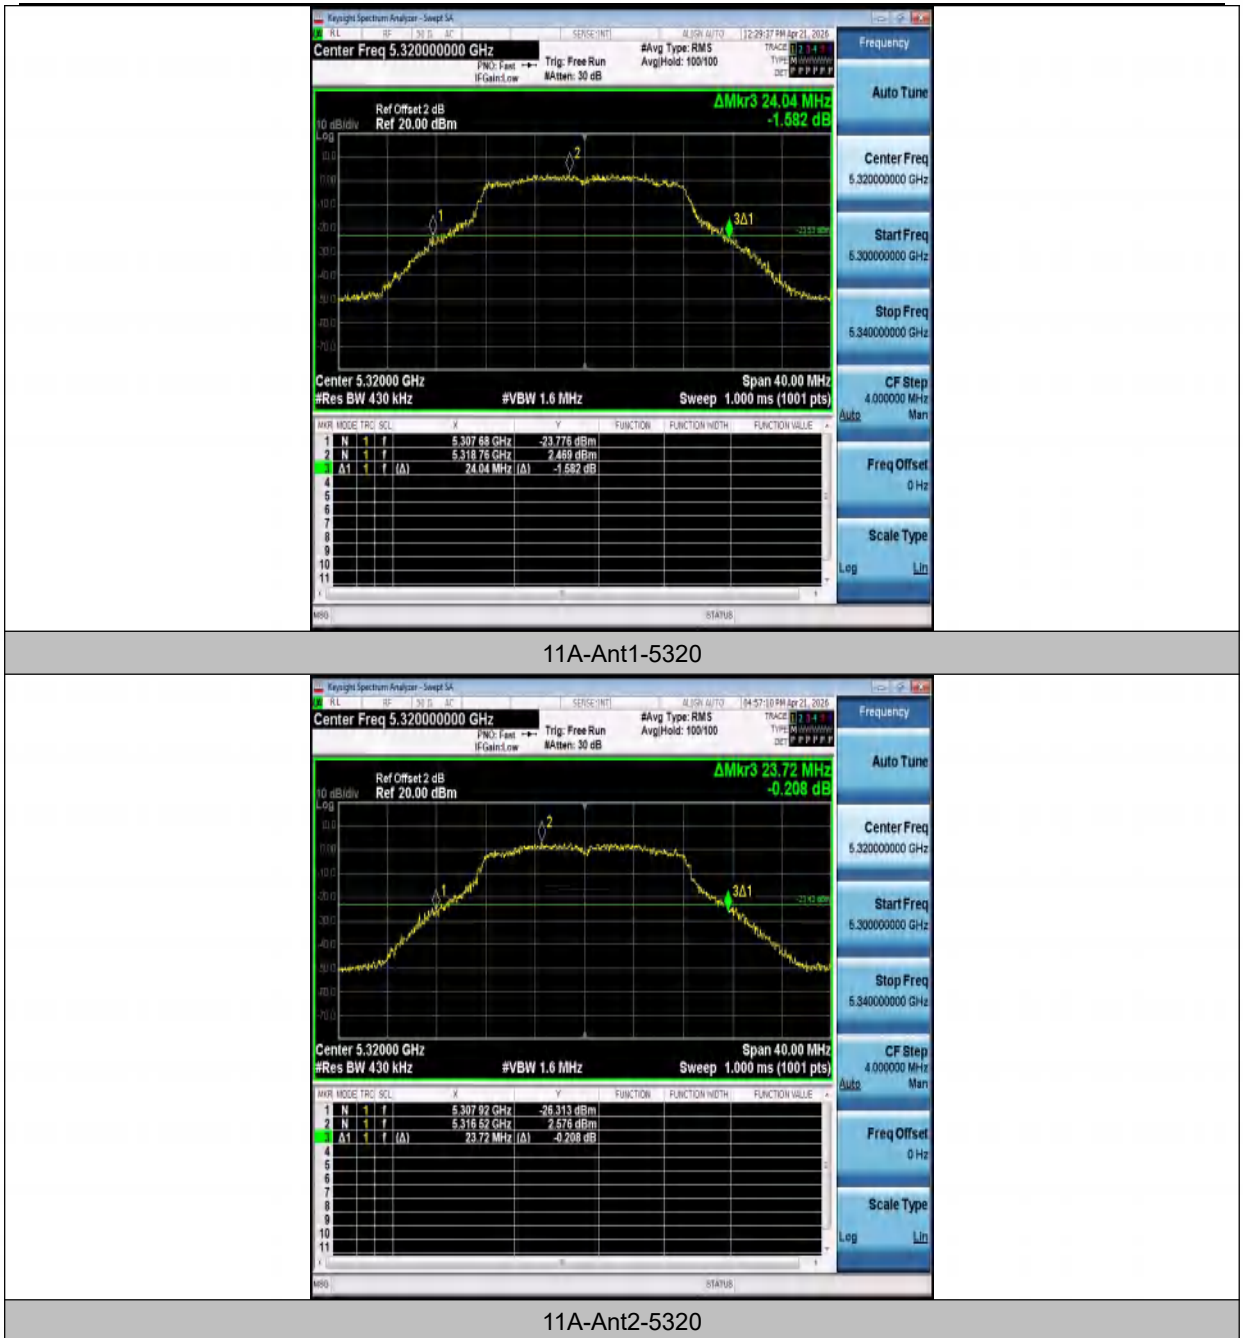


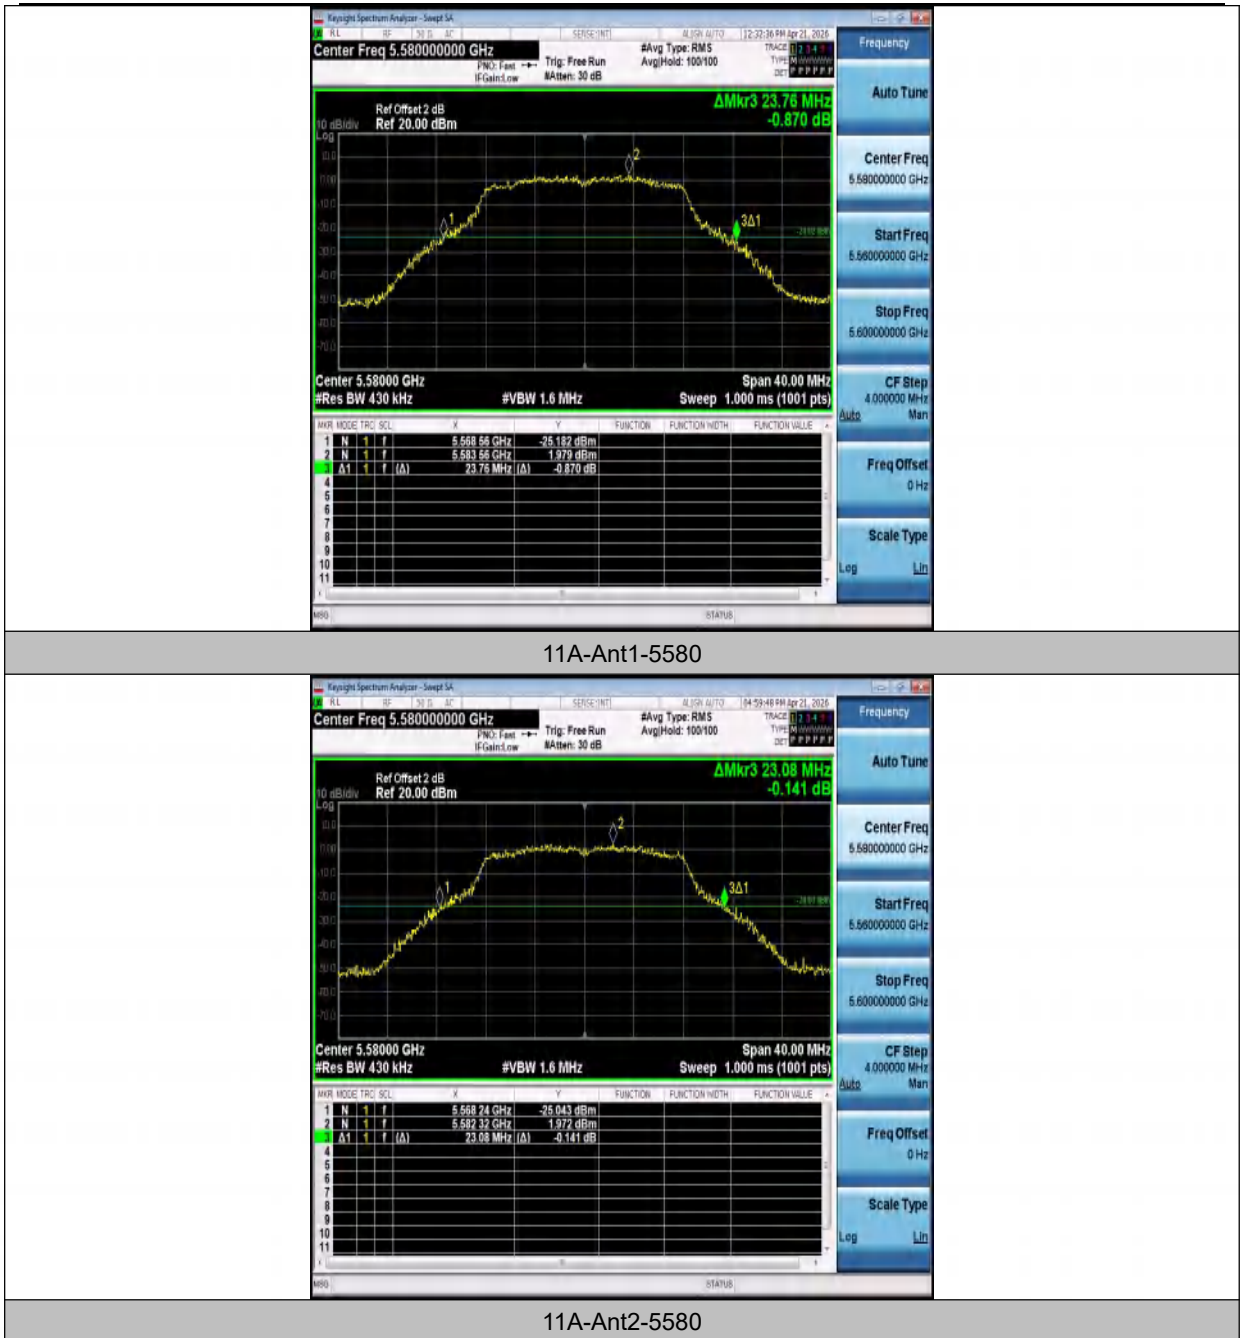


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

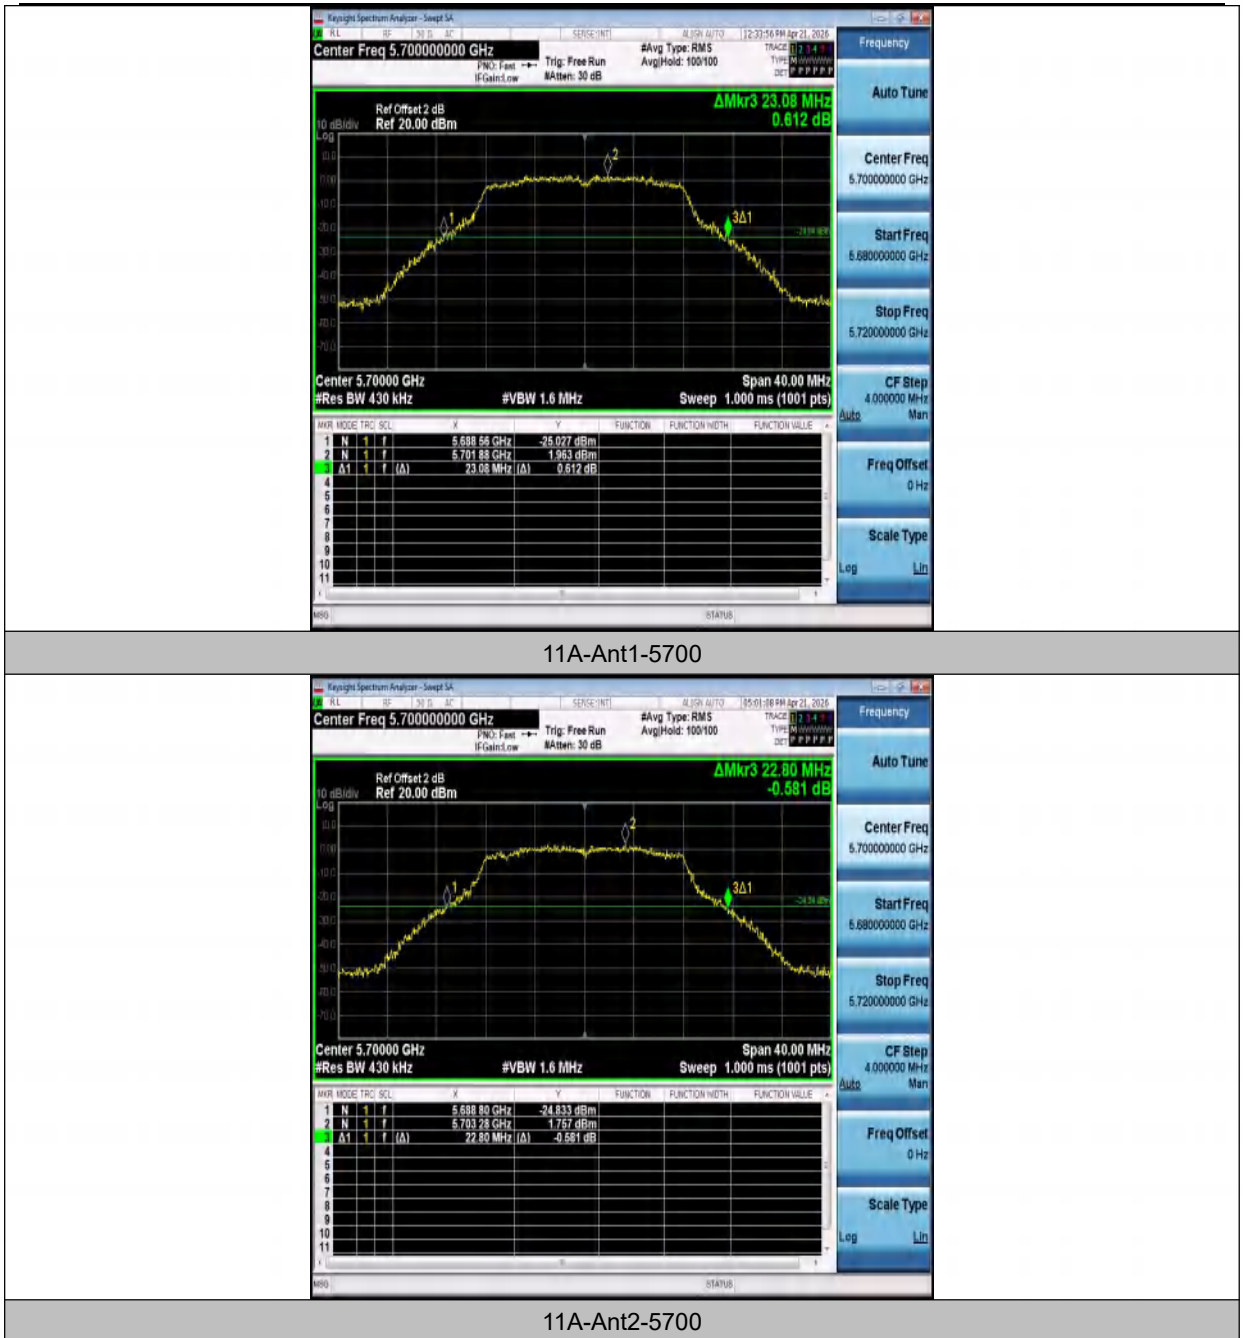



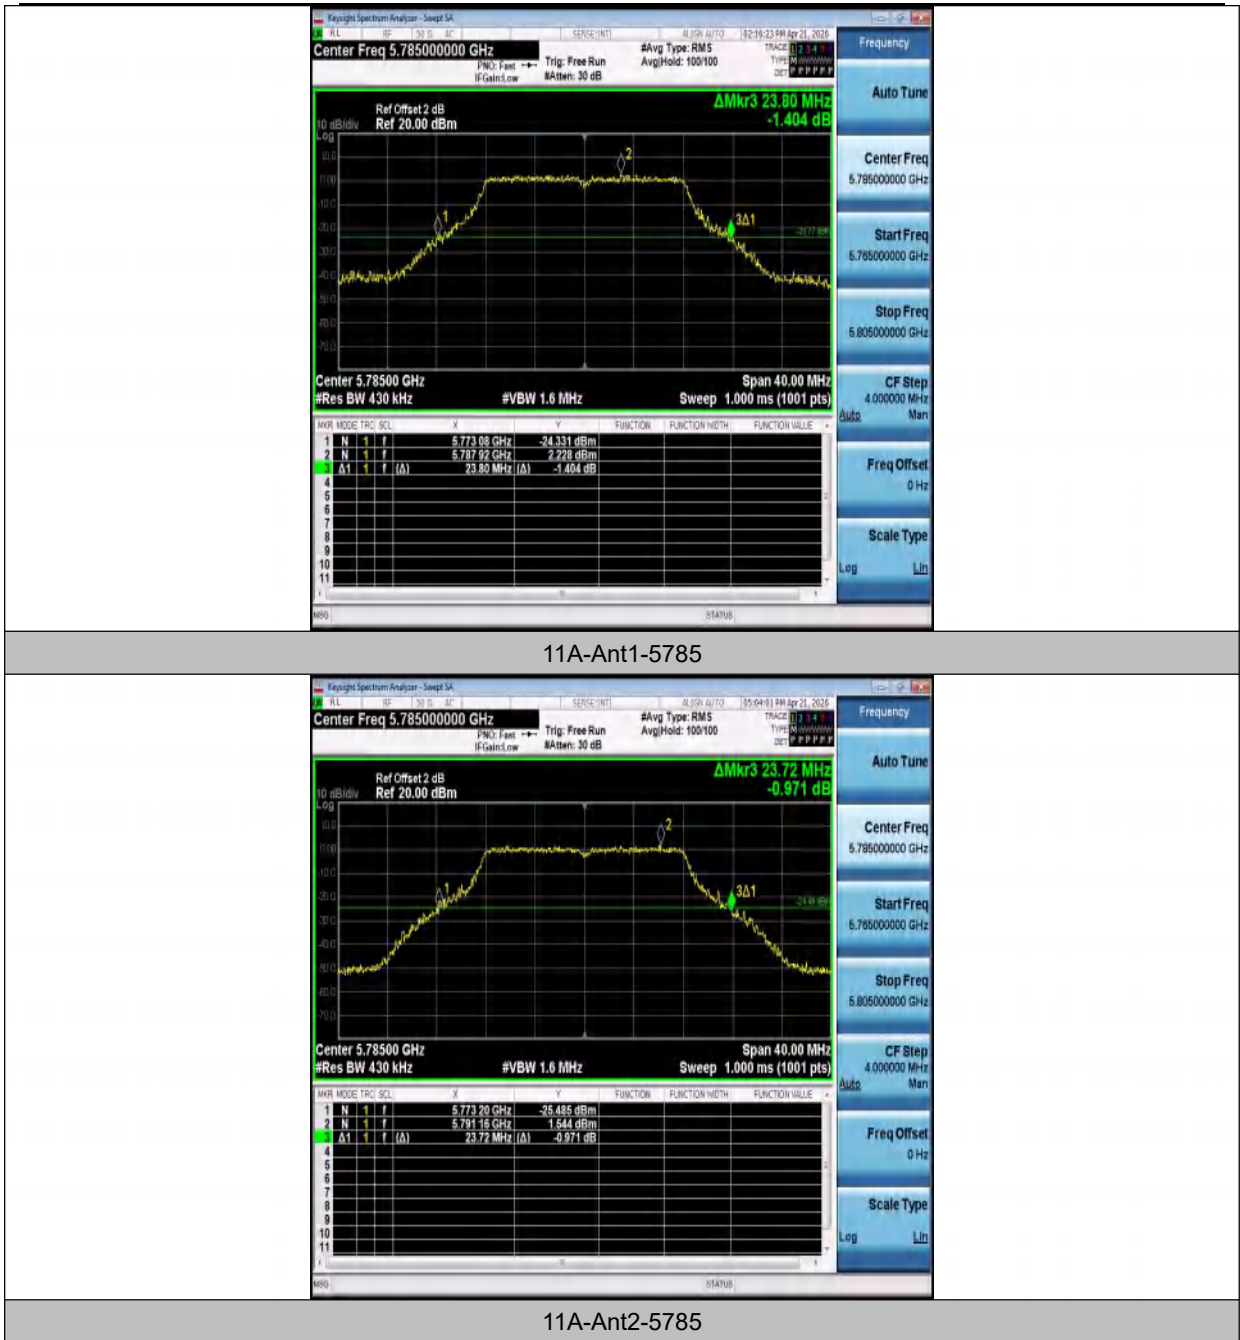






11A-Ant1-5825





11A-Ant2-5825

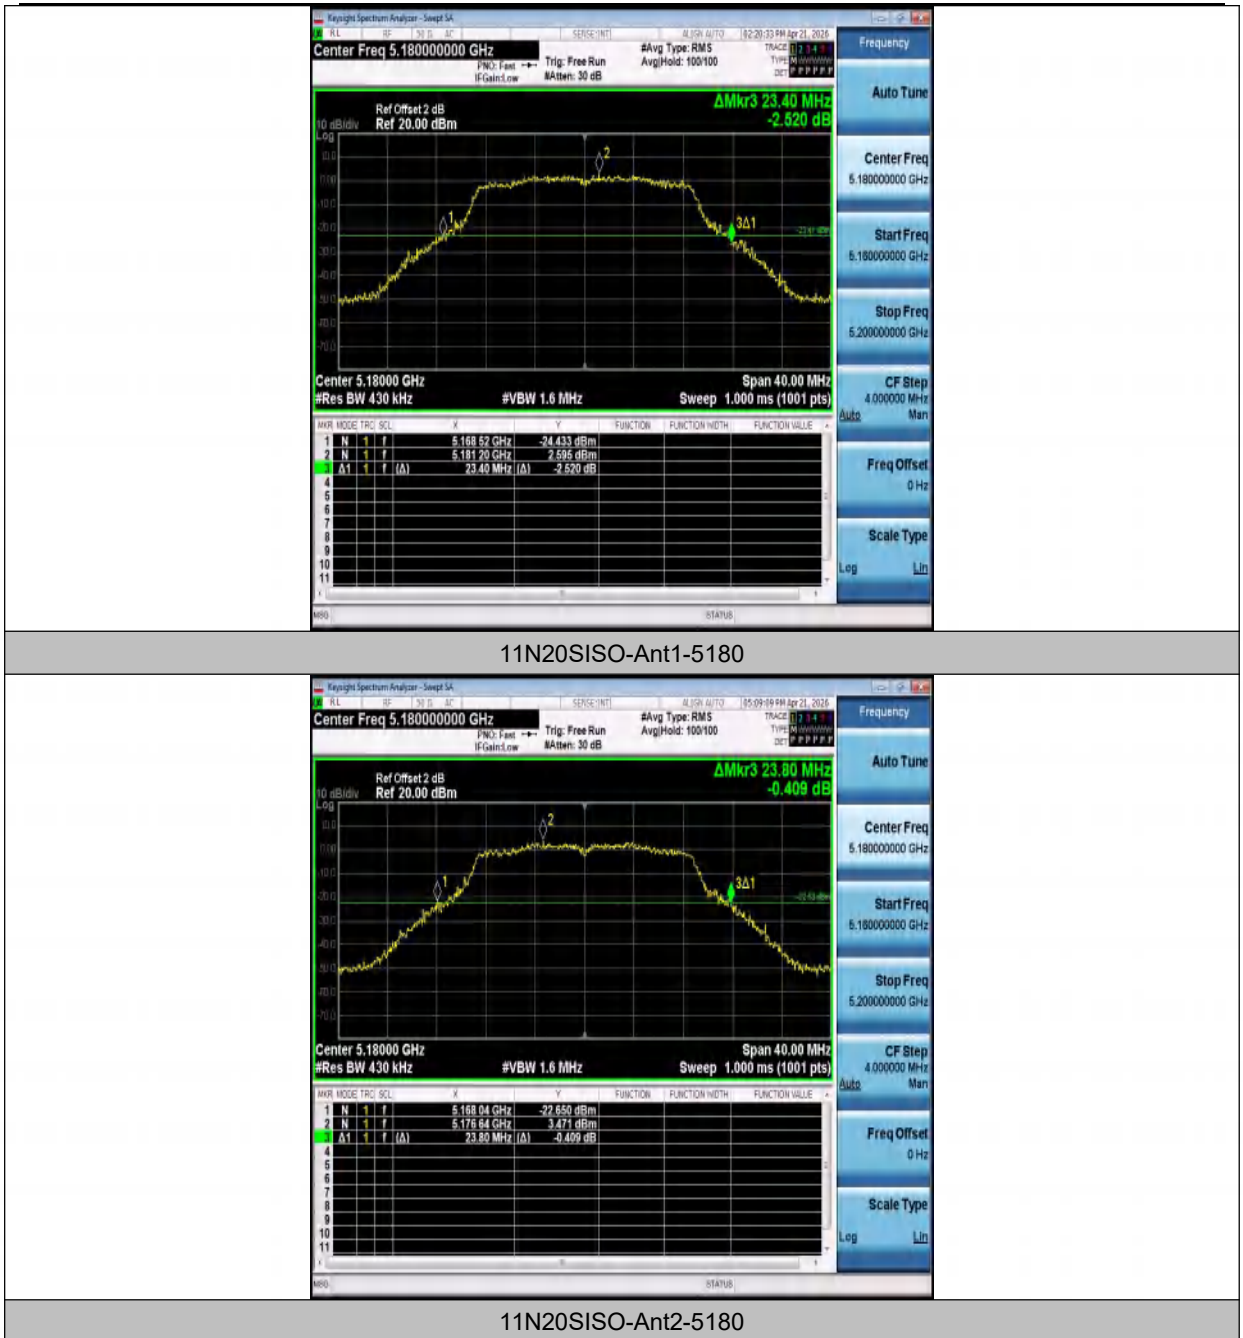

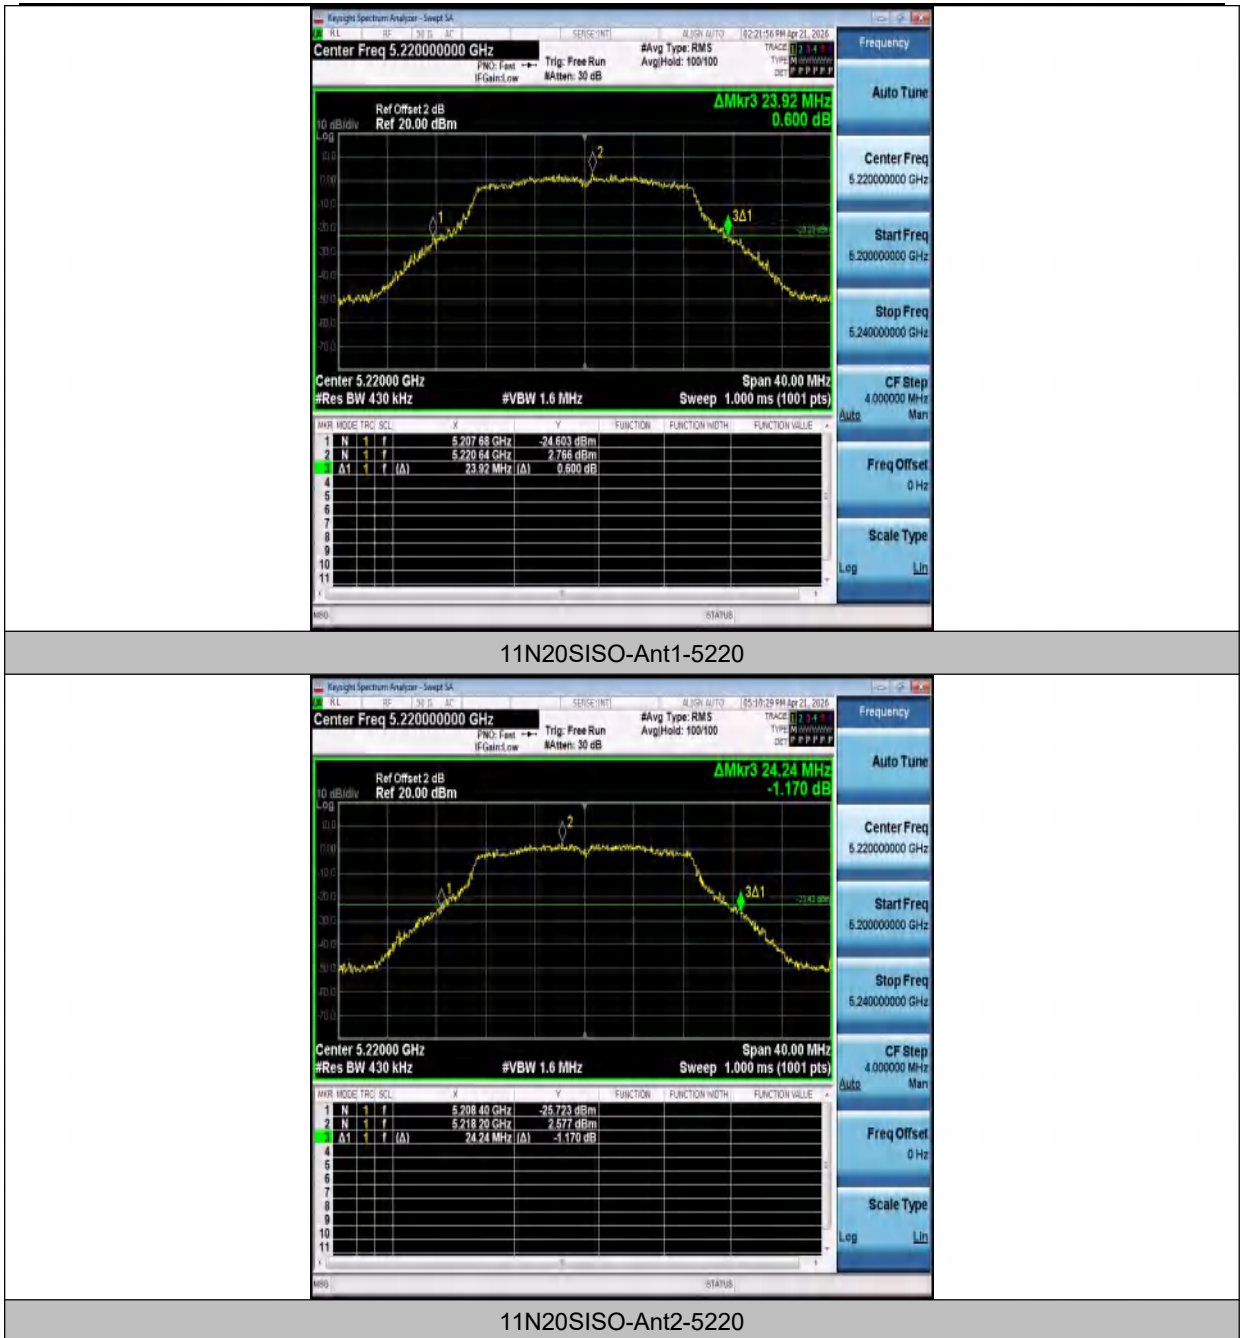

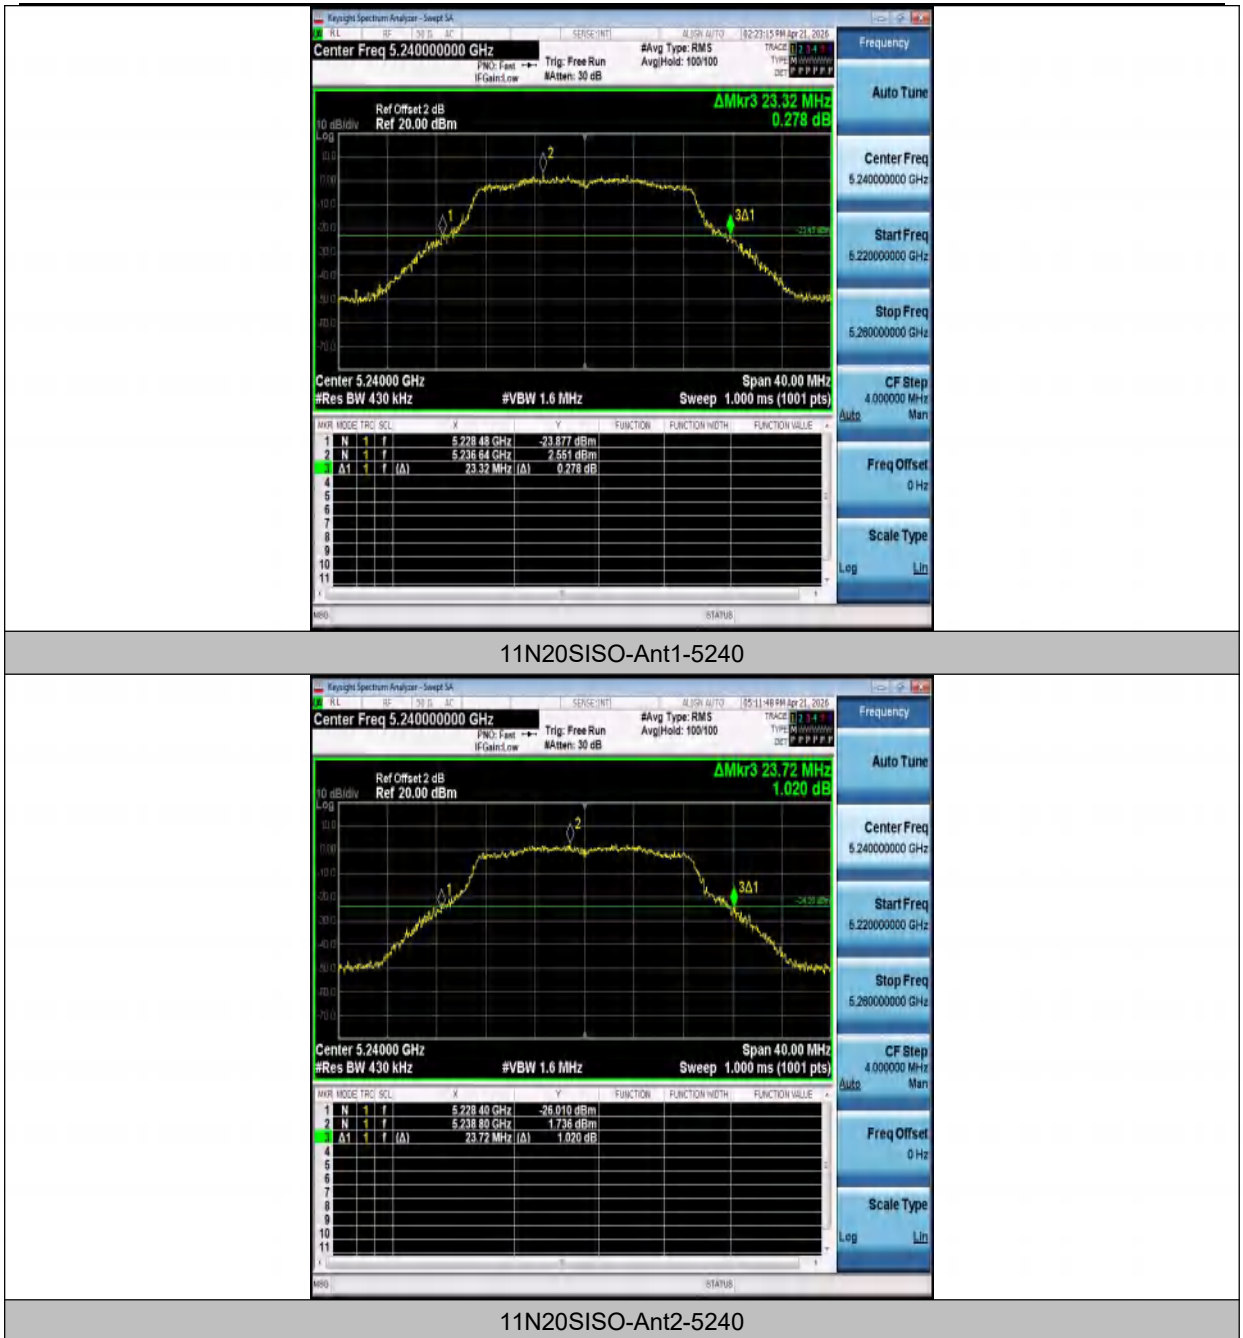

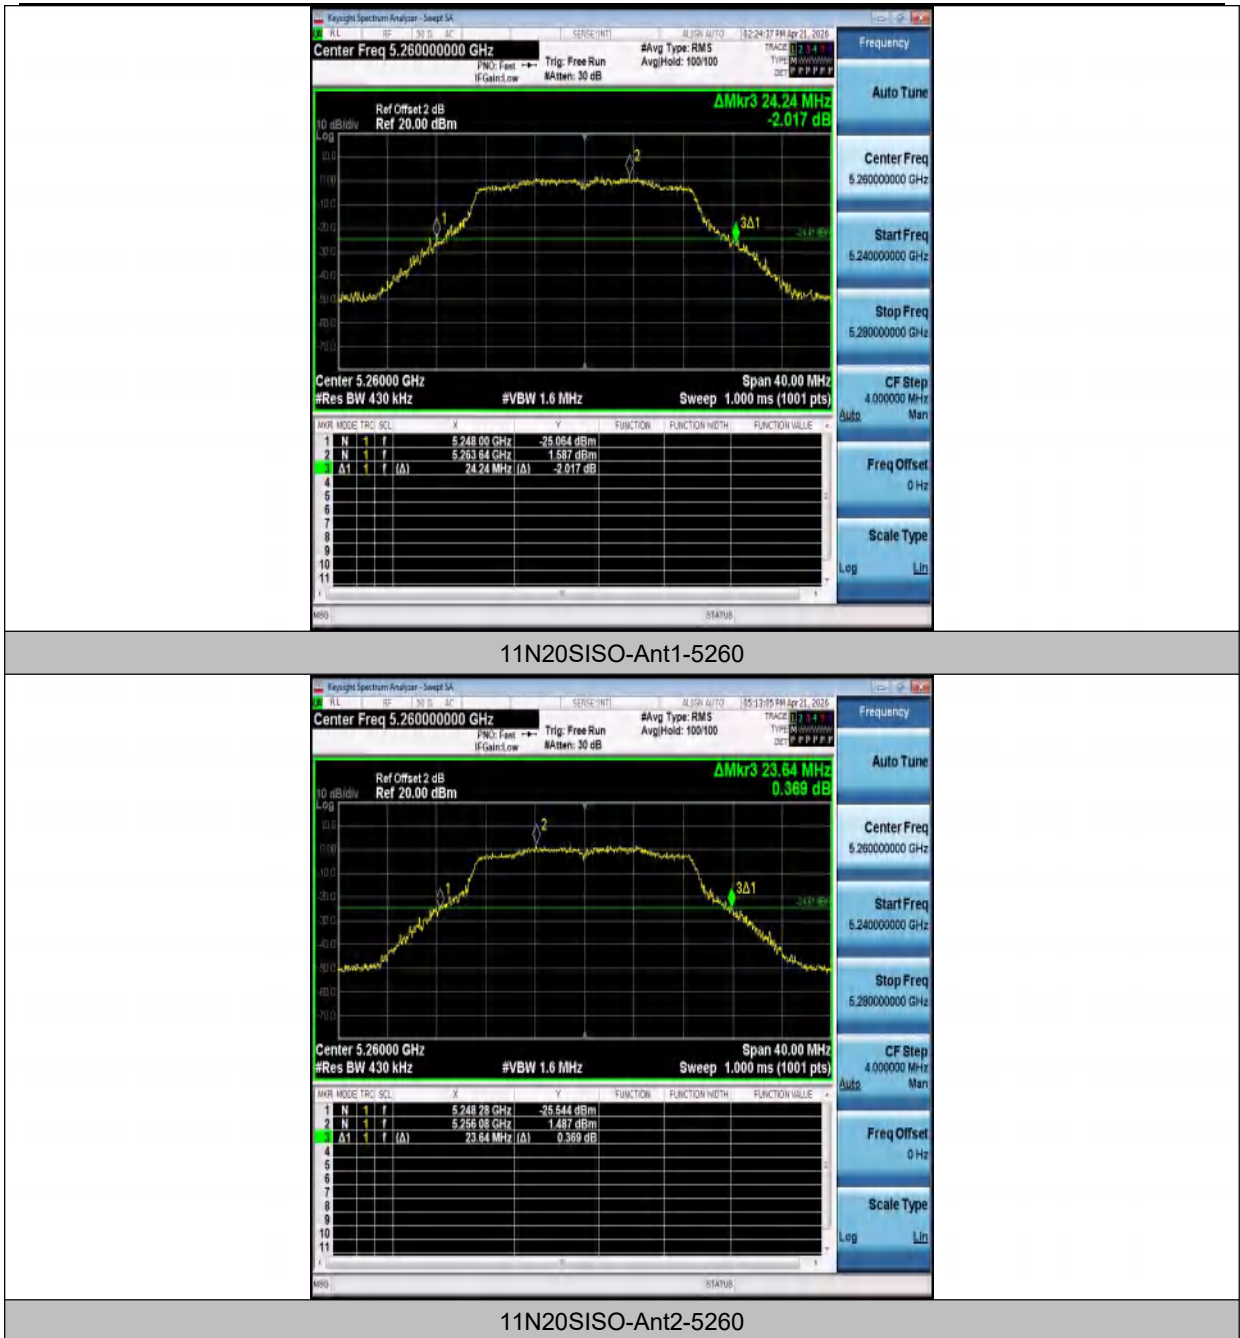


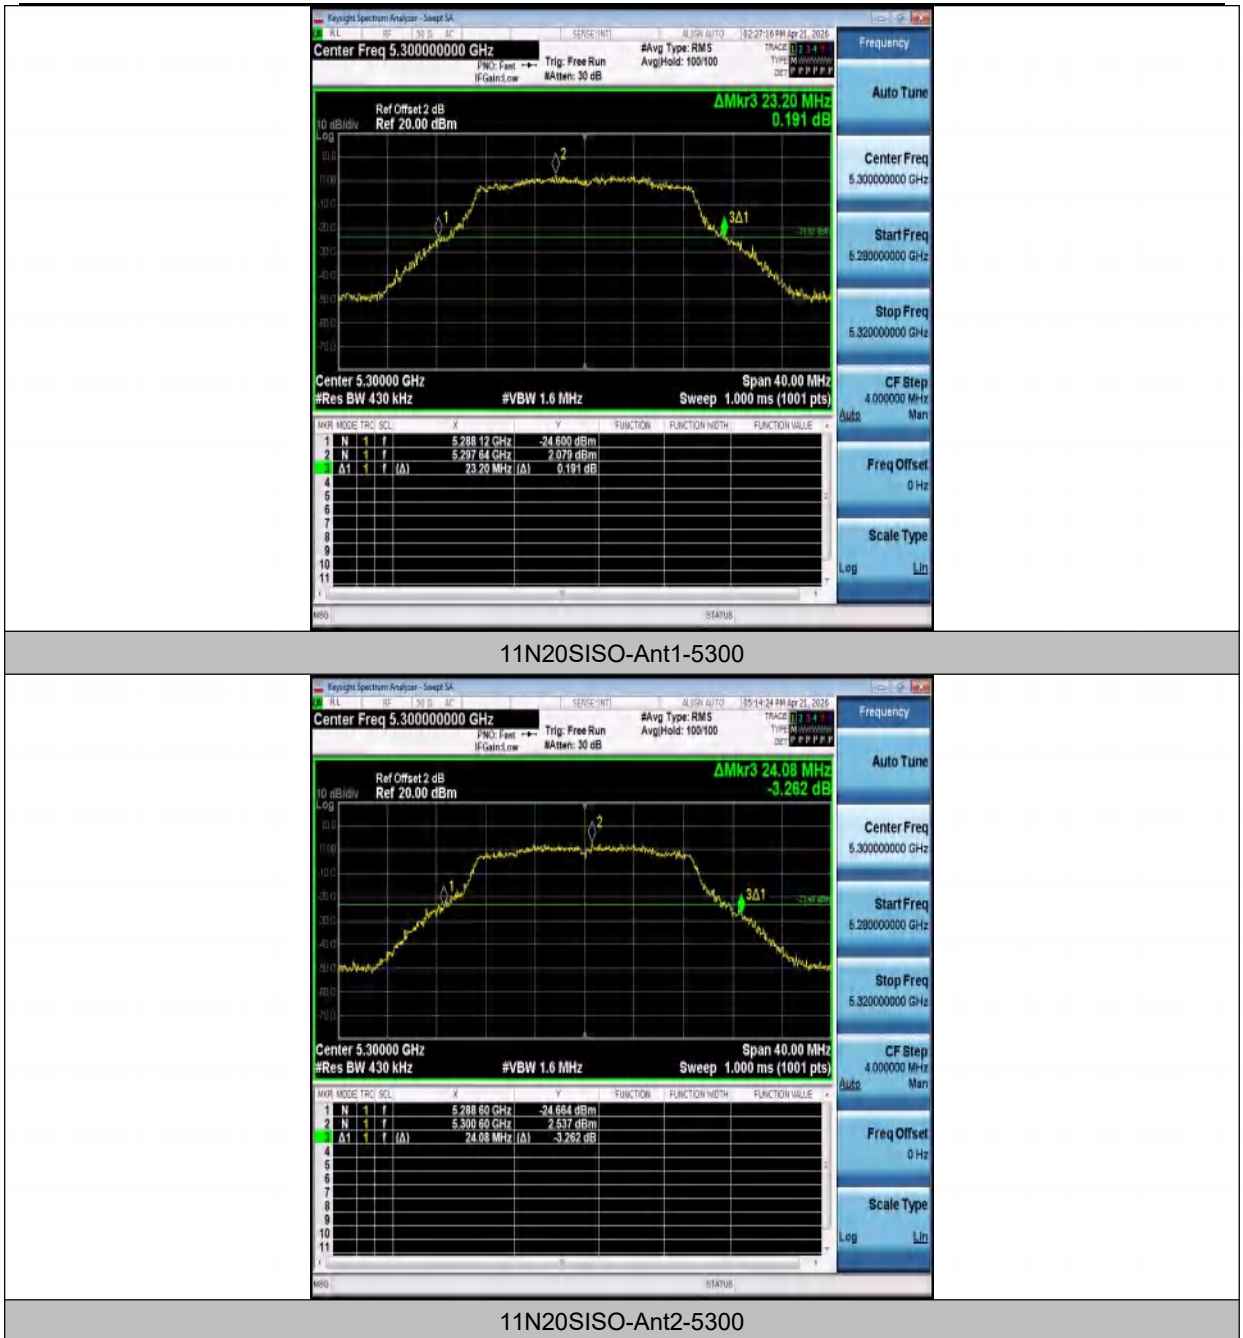



Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

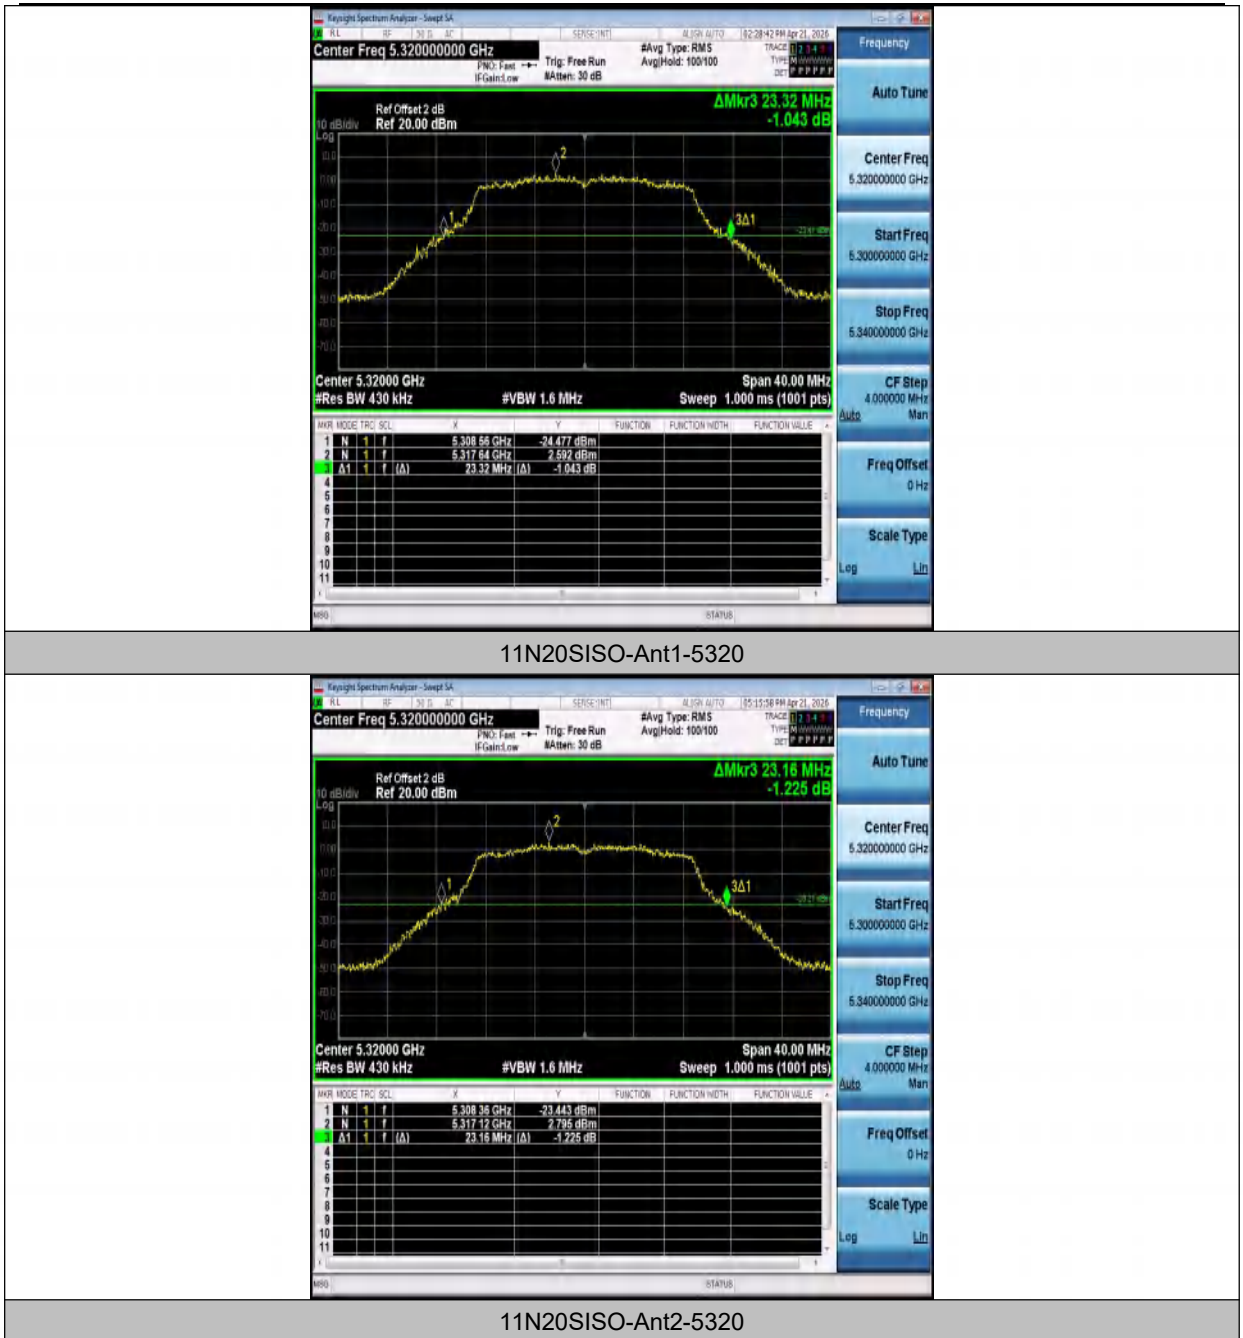

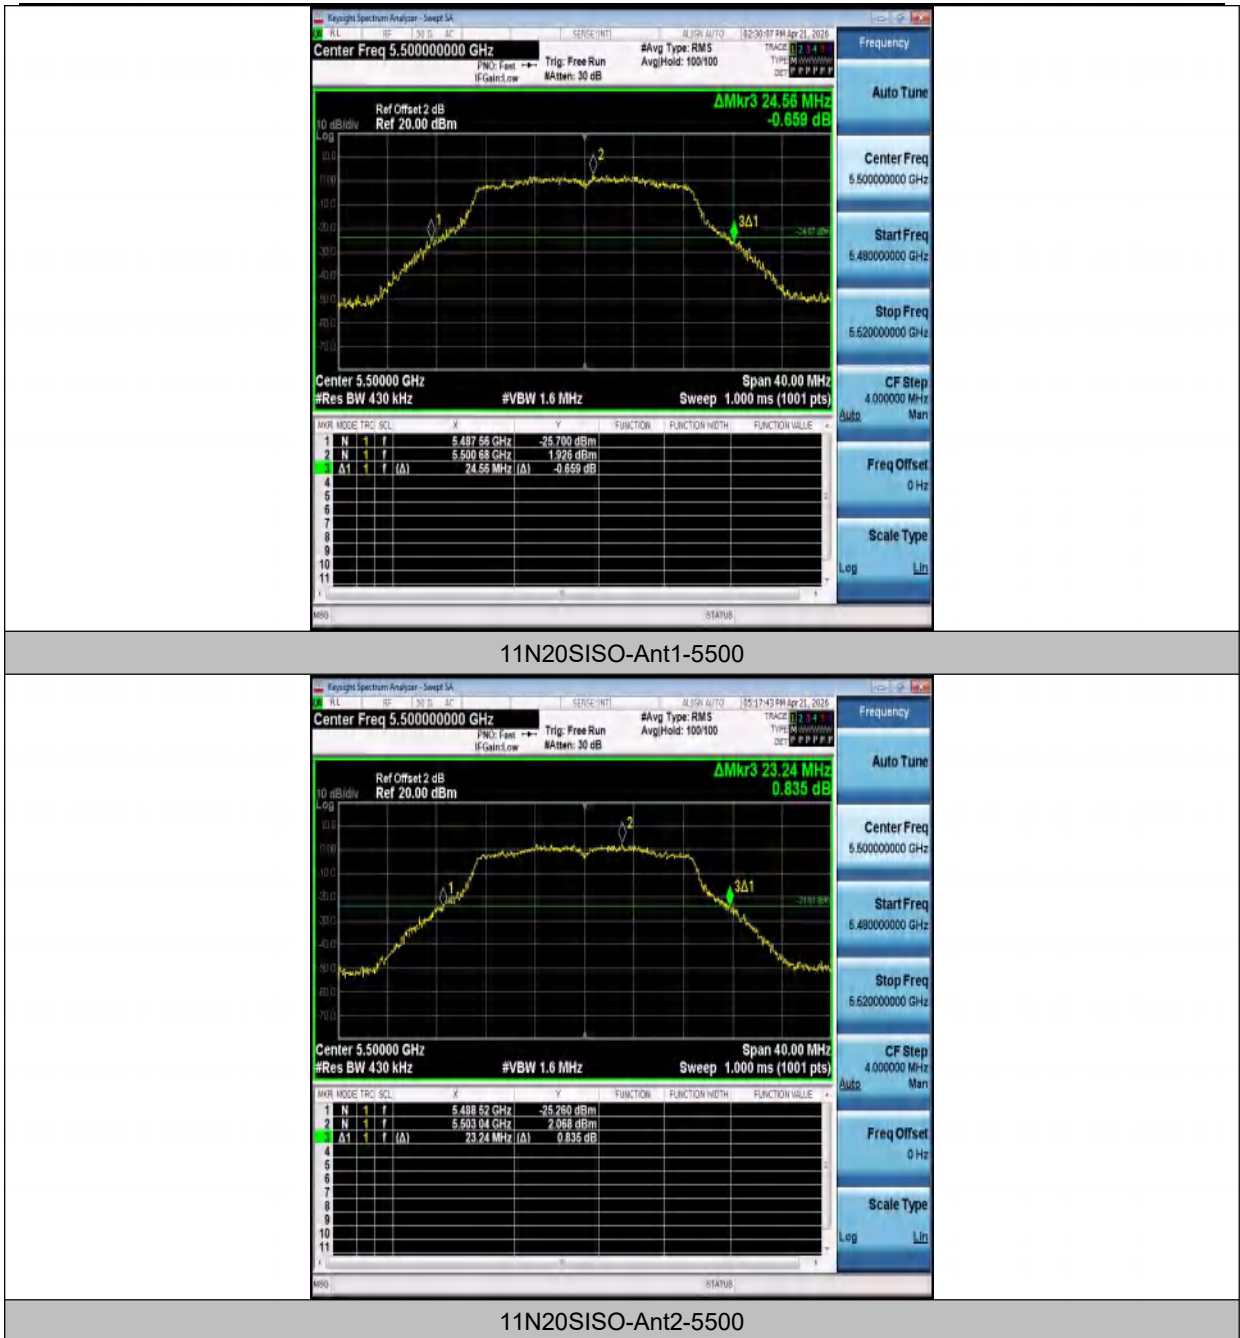

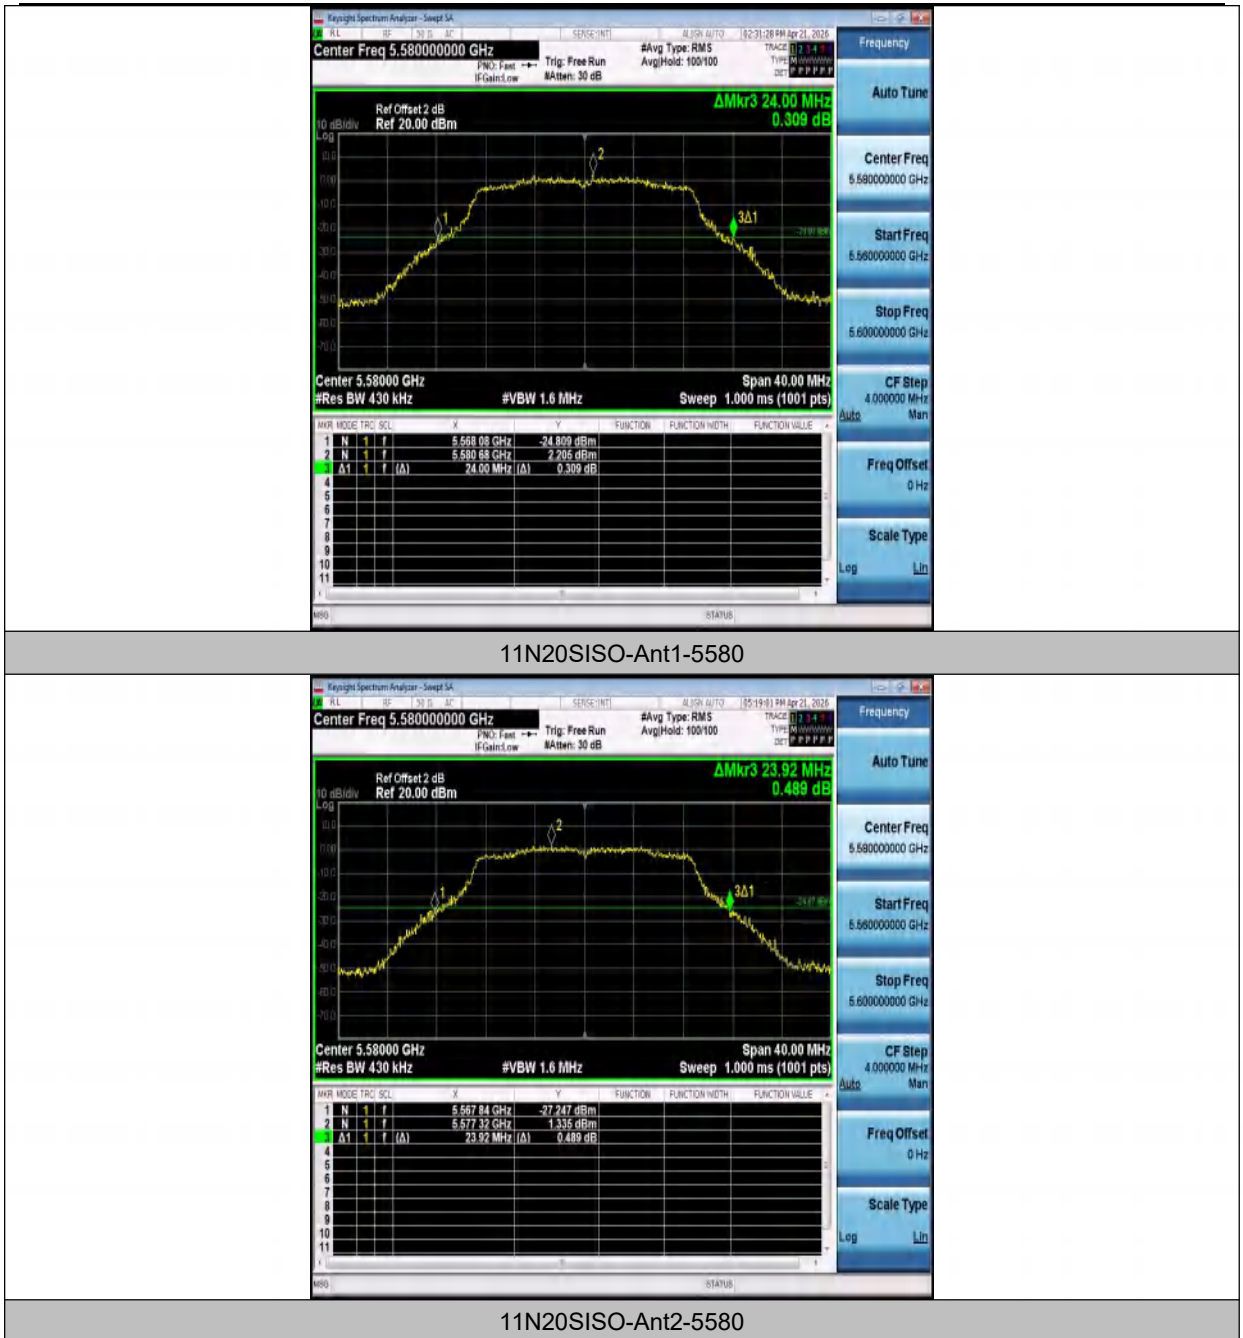


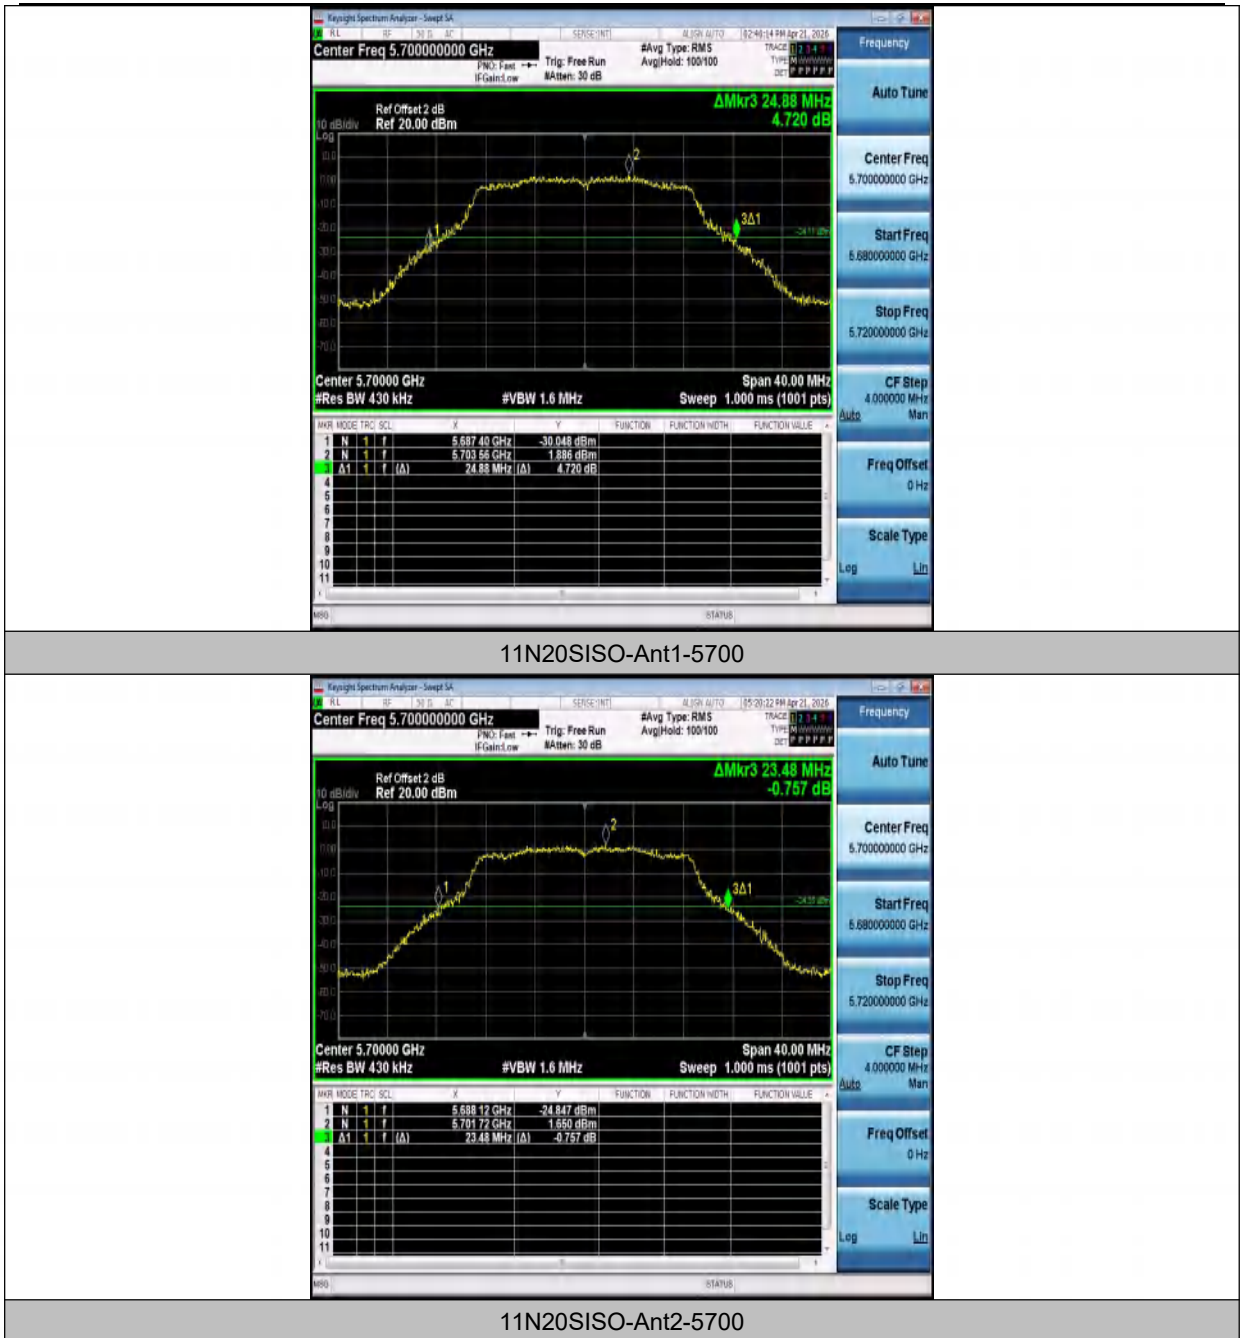


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

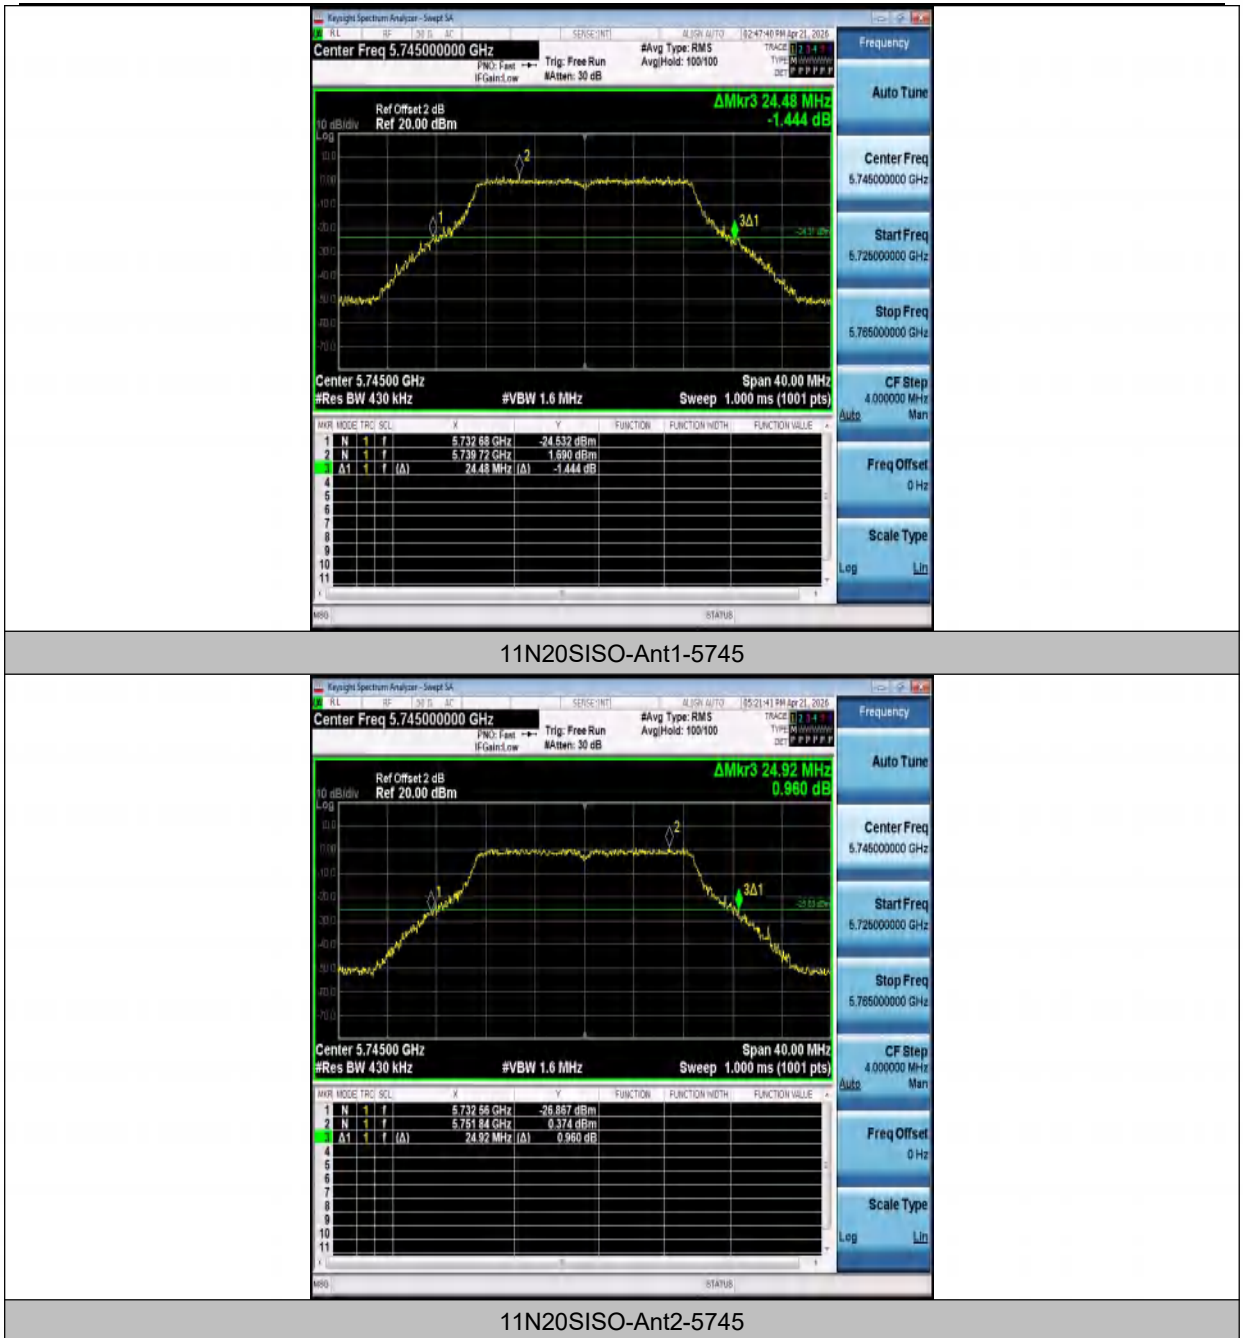


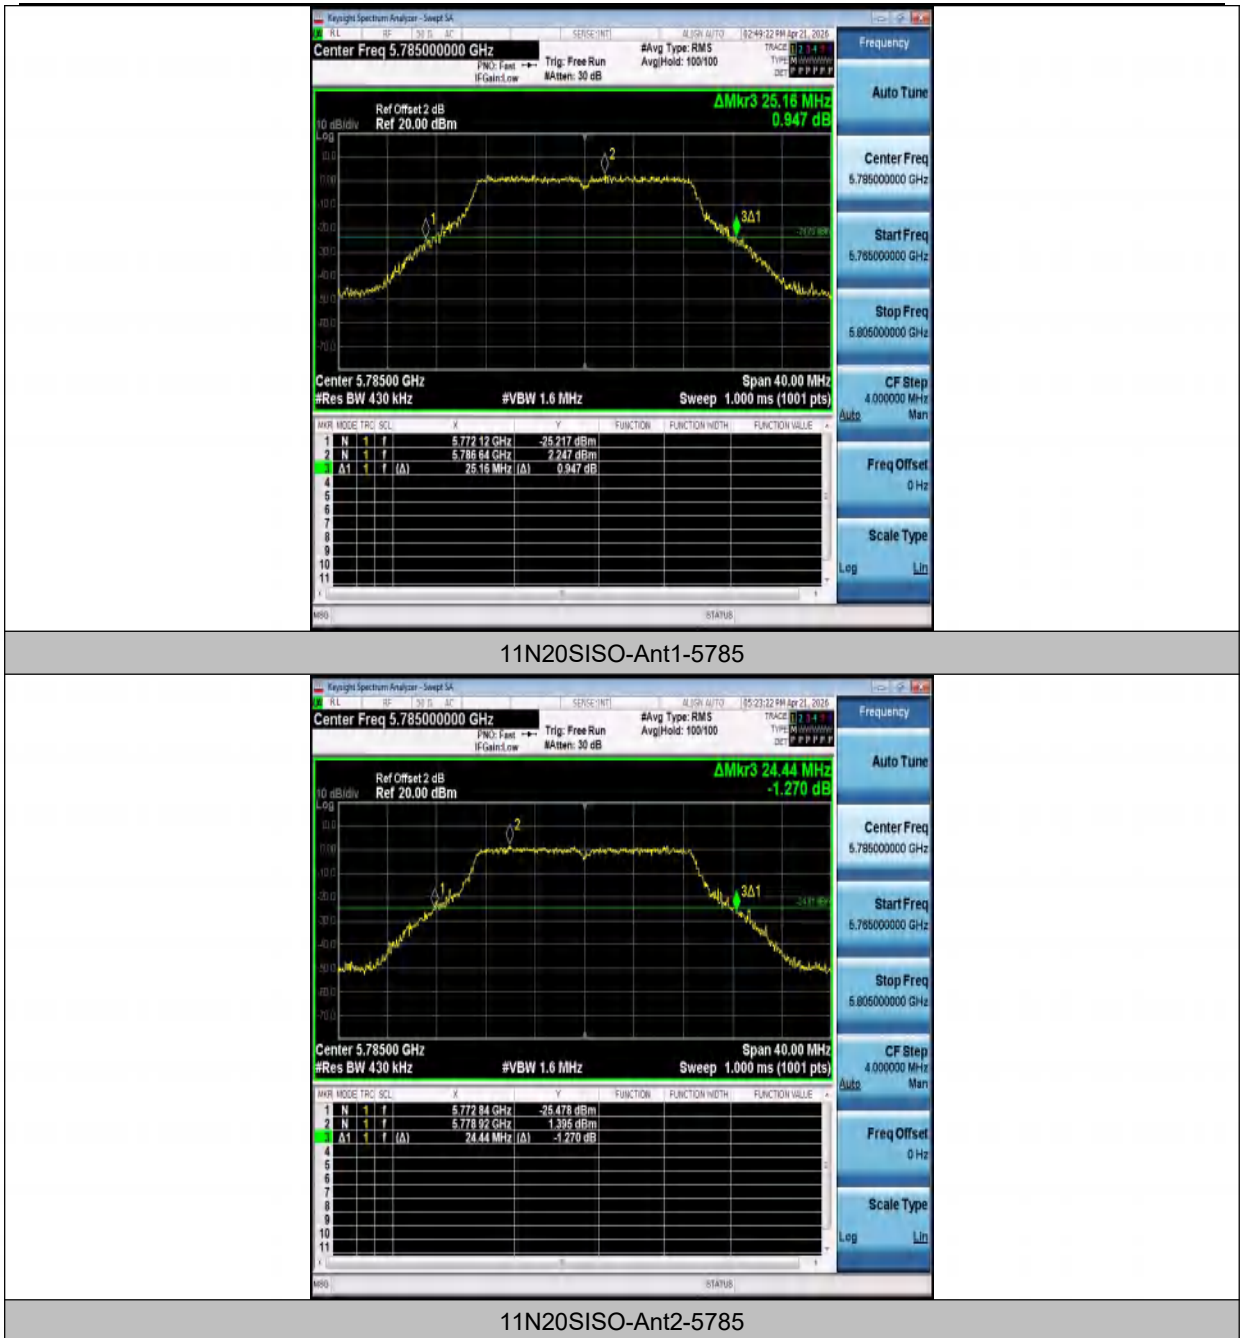

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

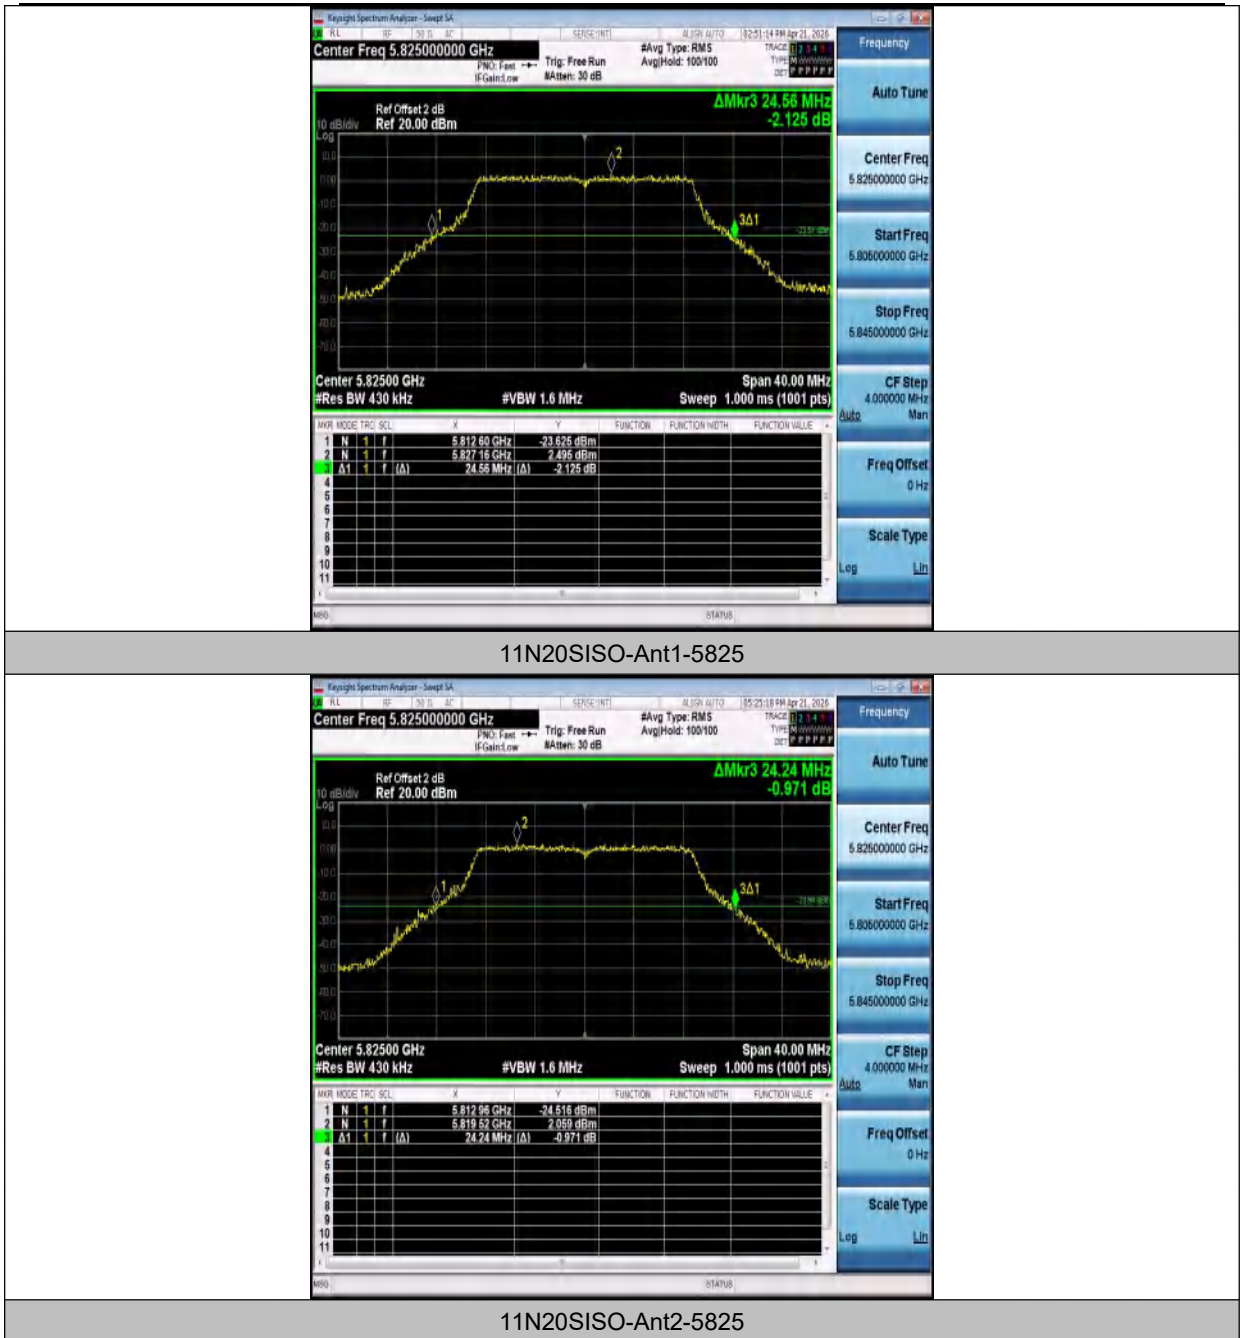


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

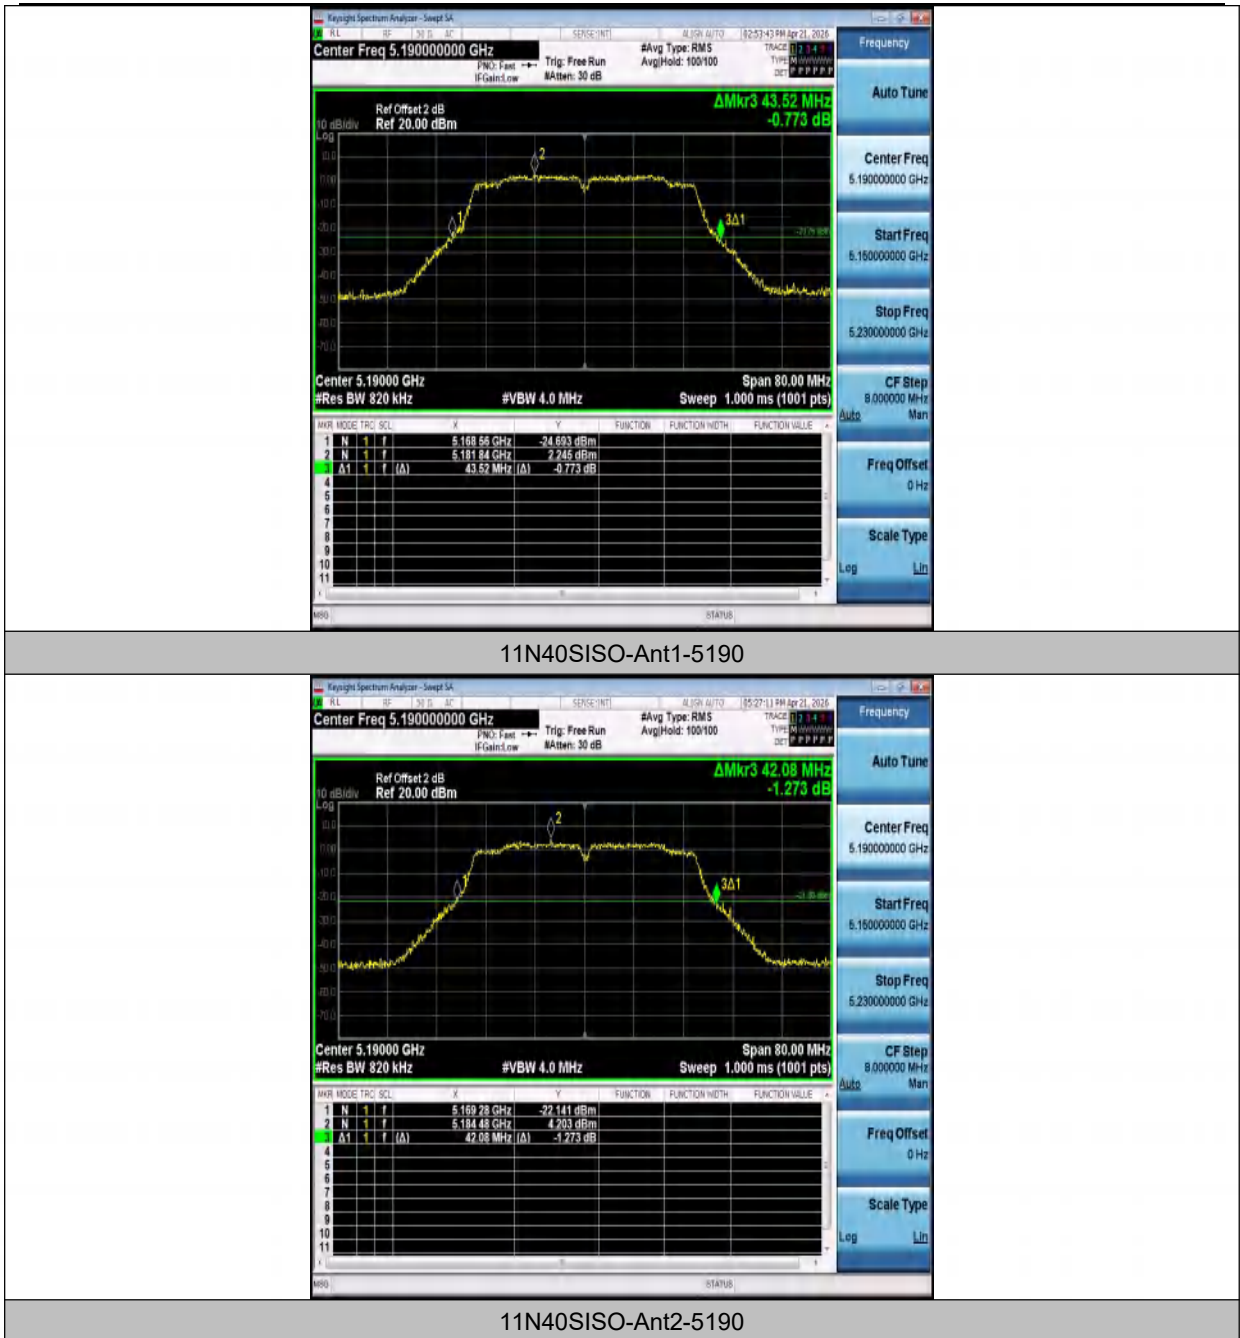


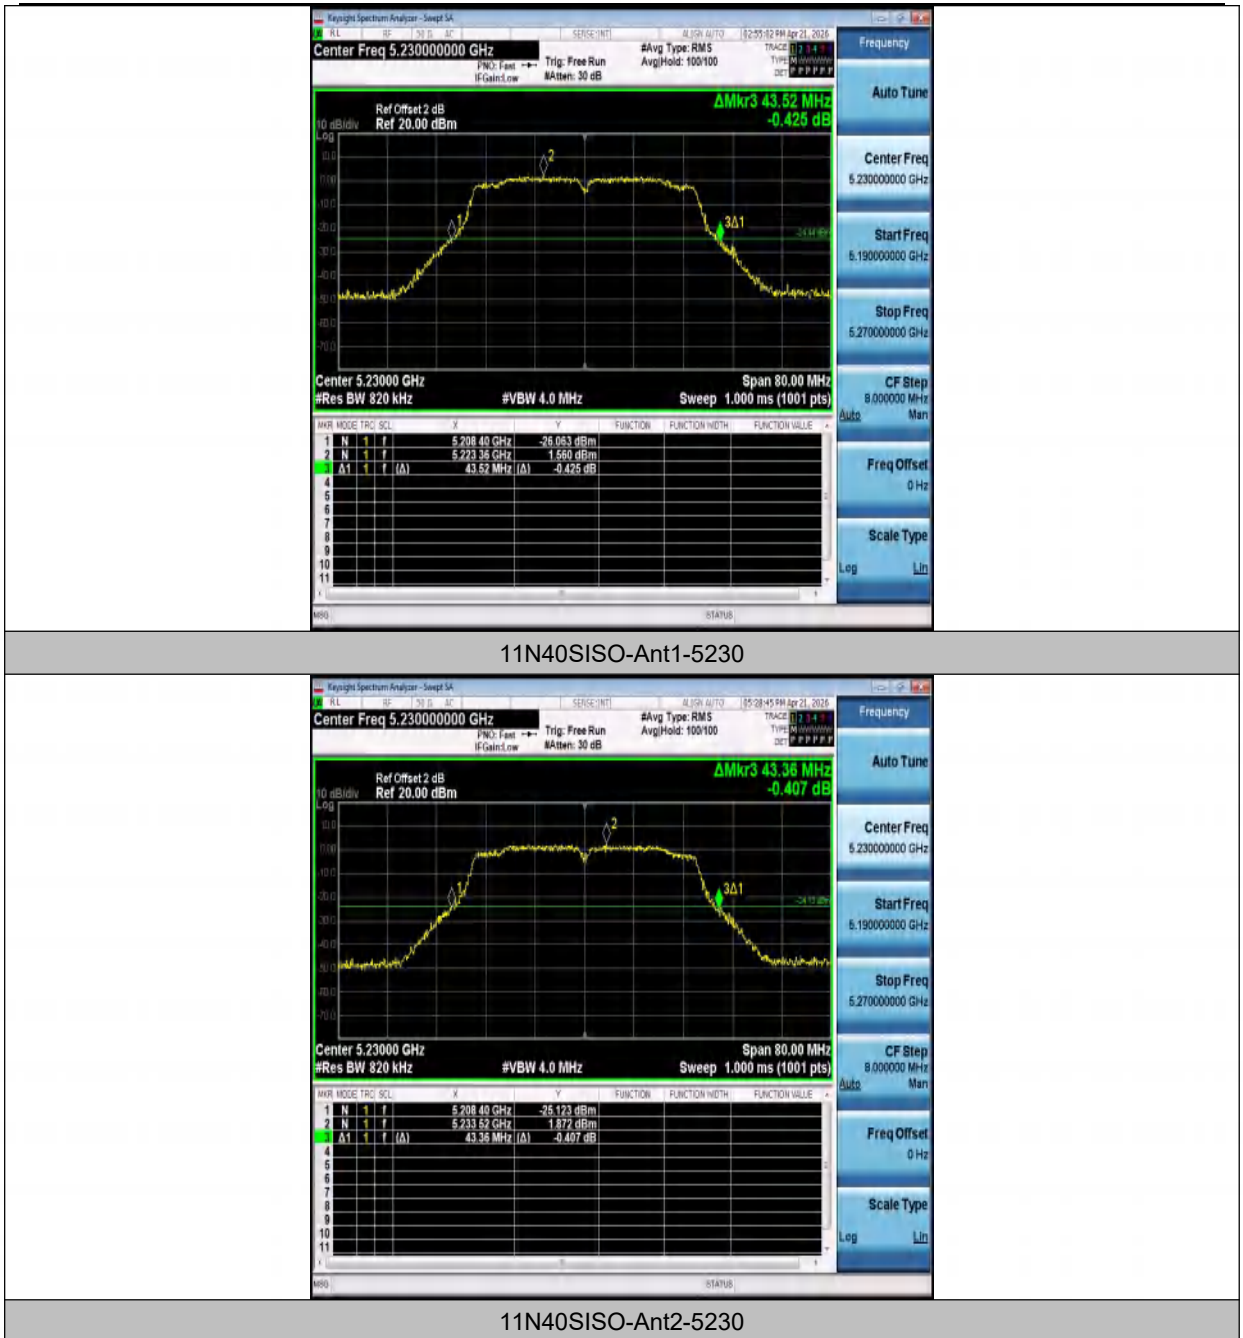


Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

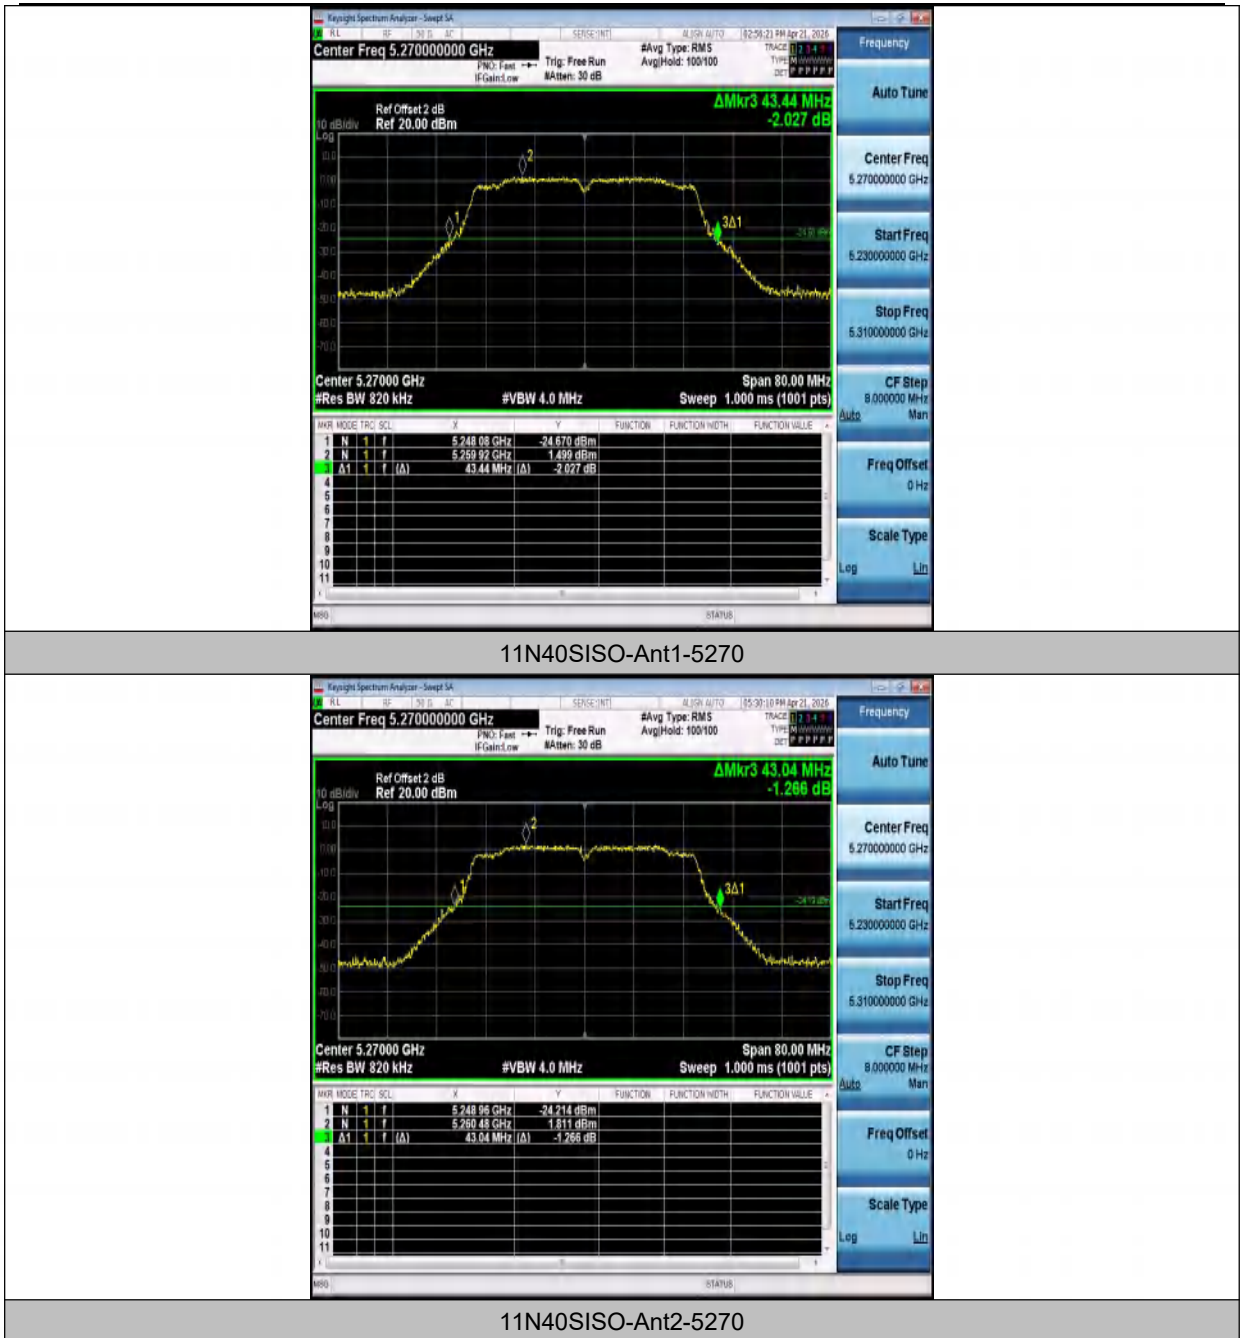

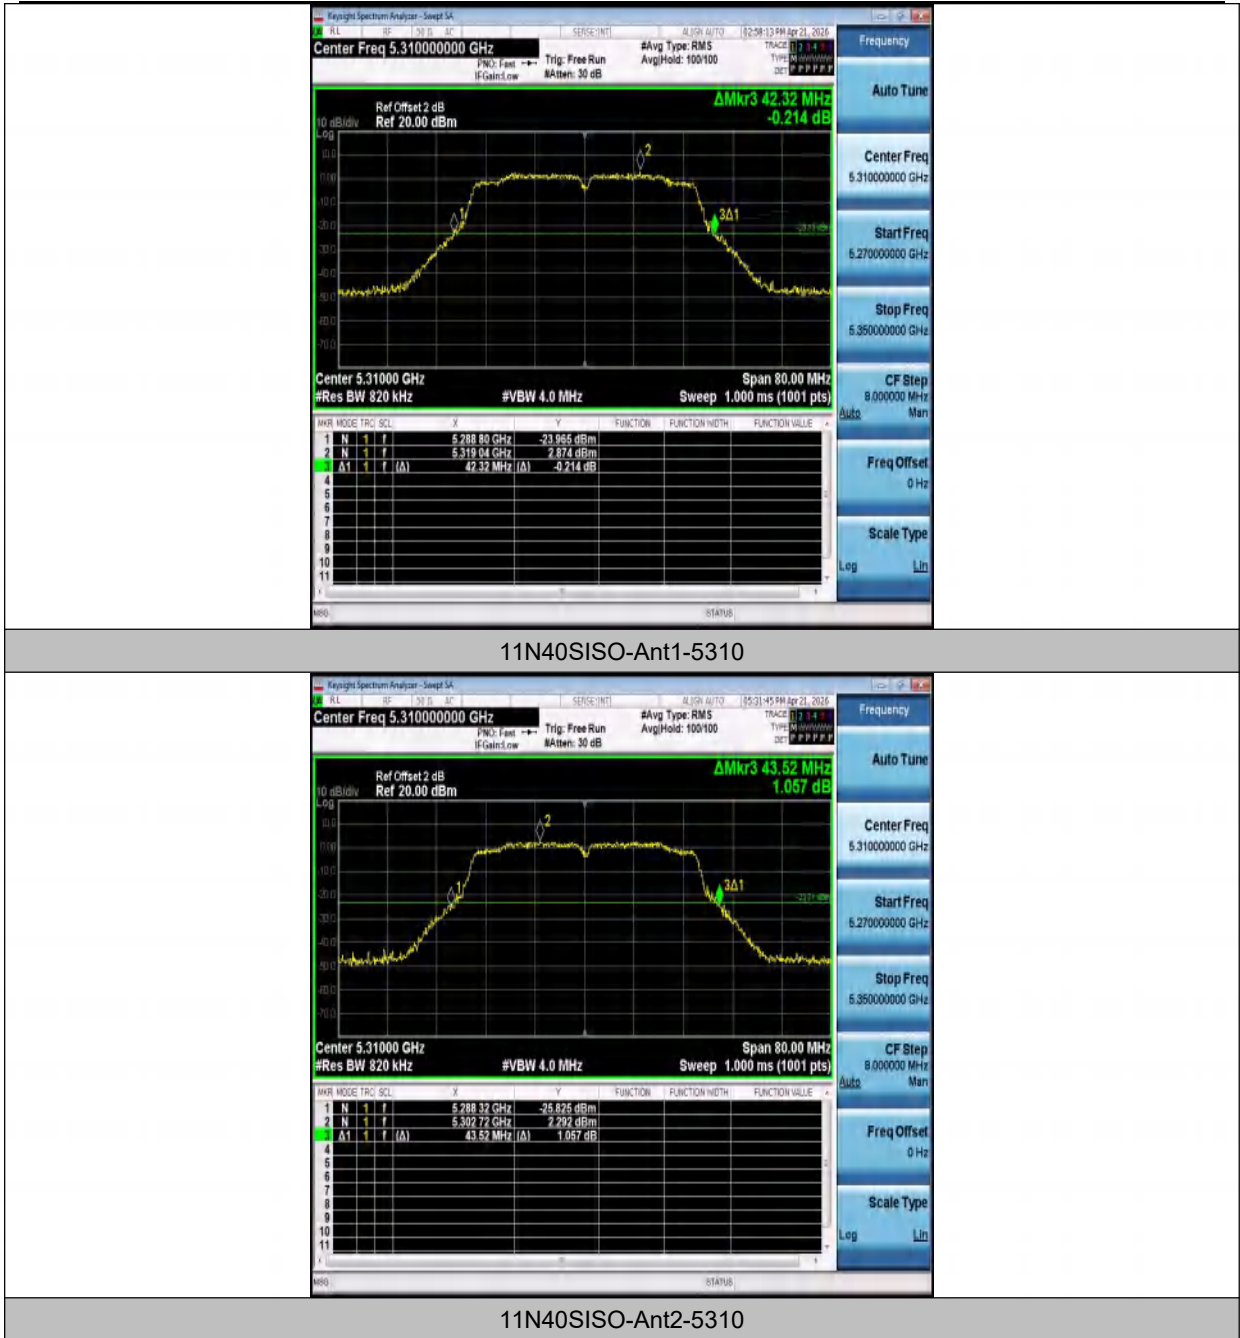



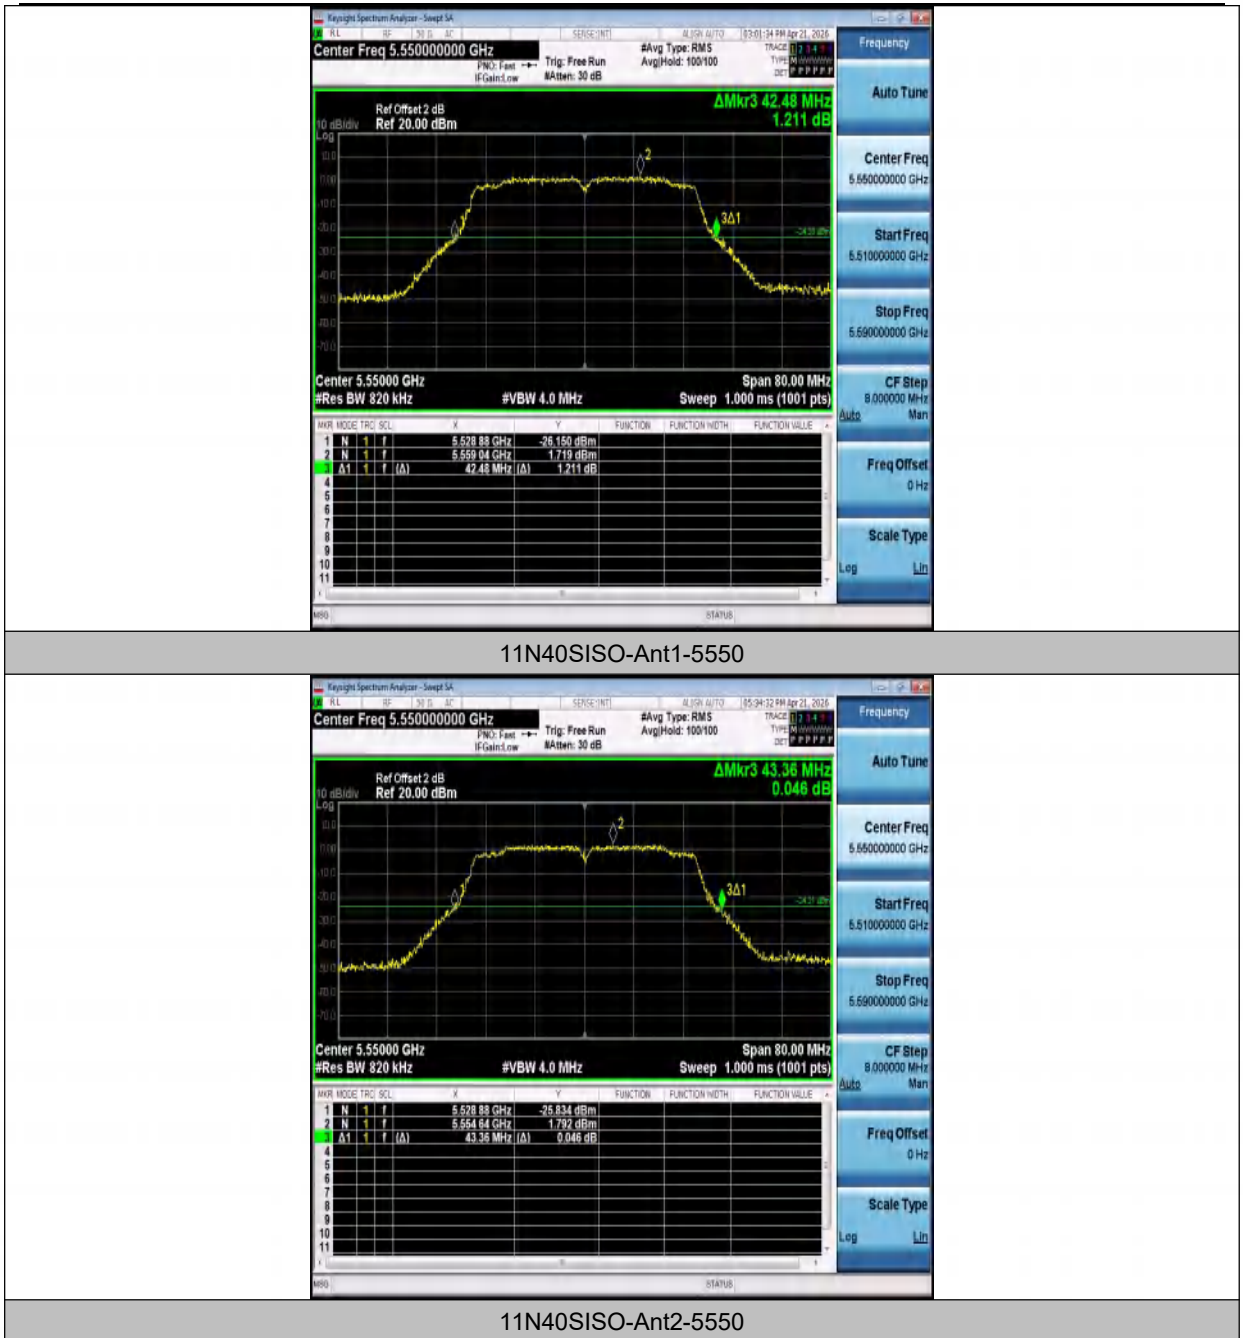

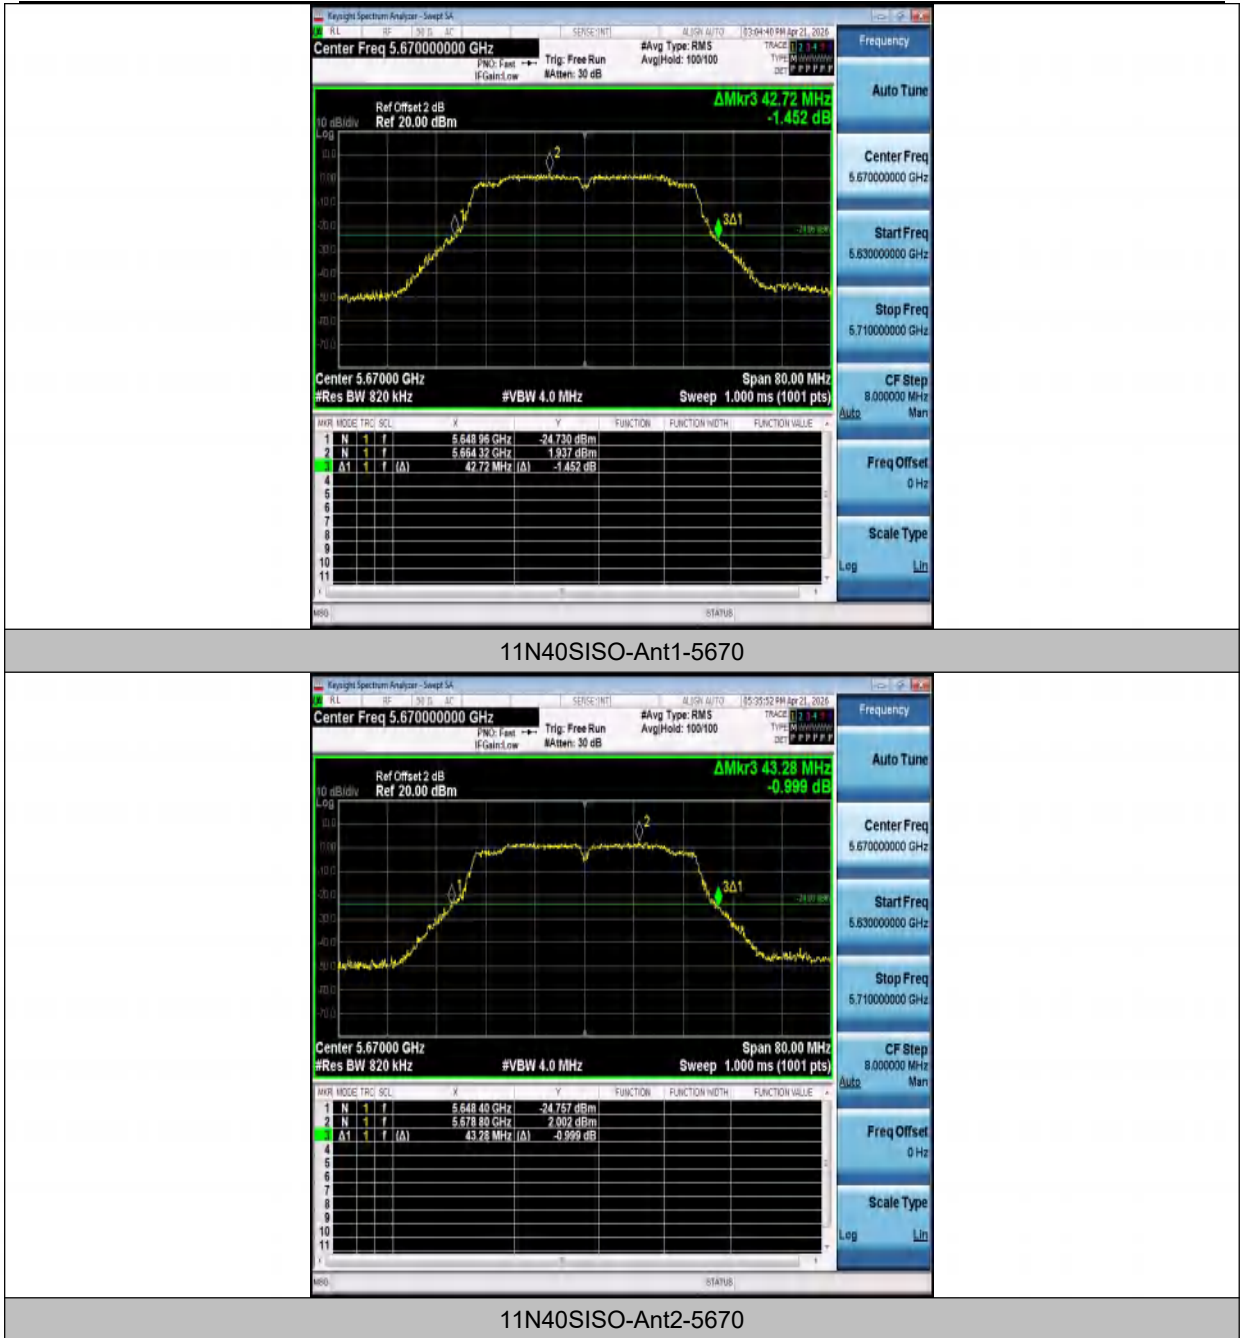



Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com




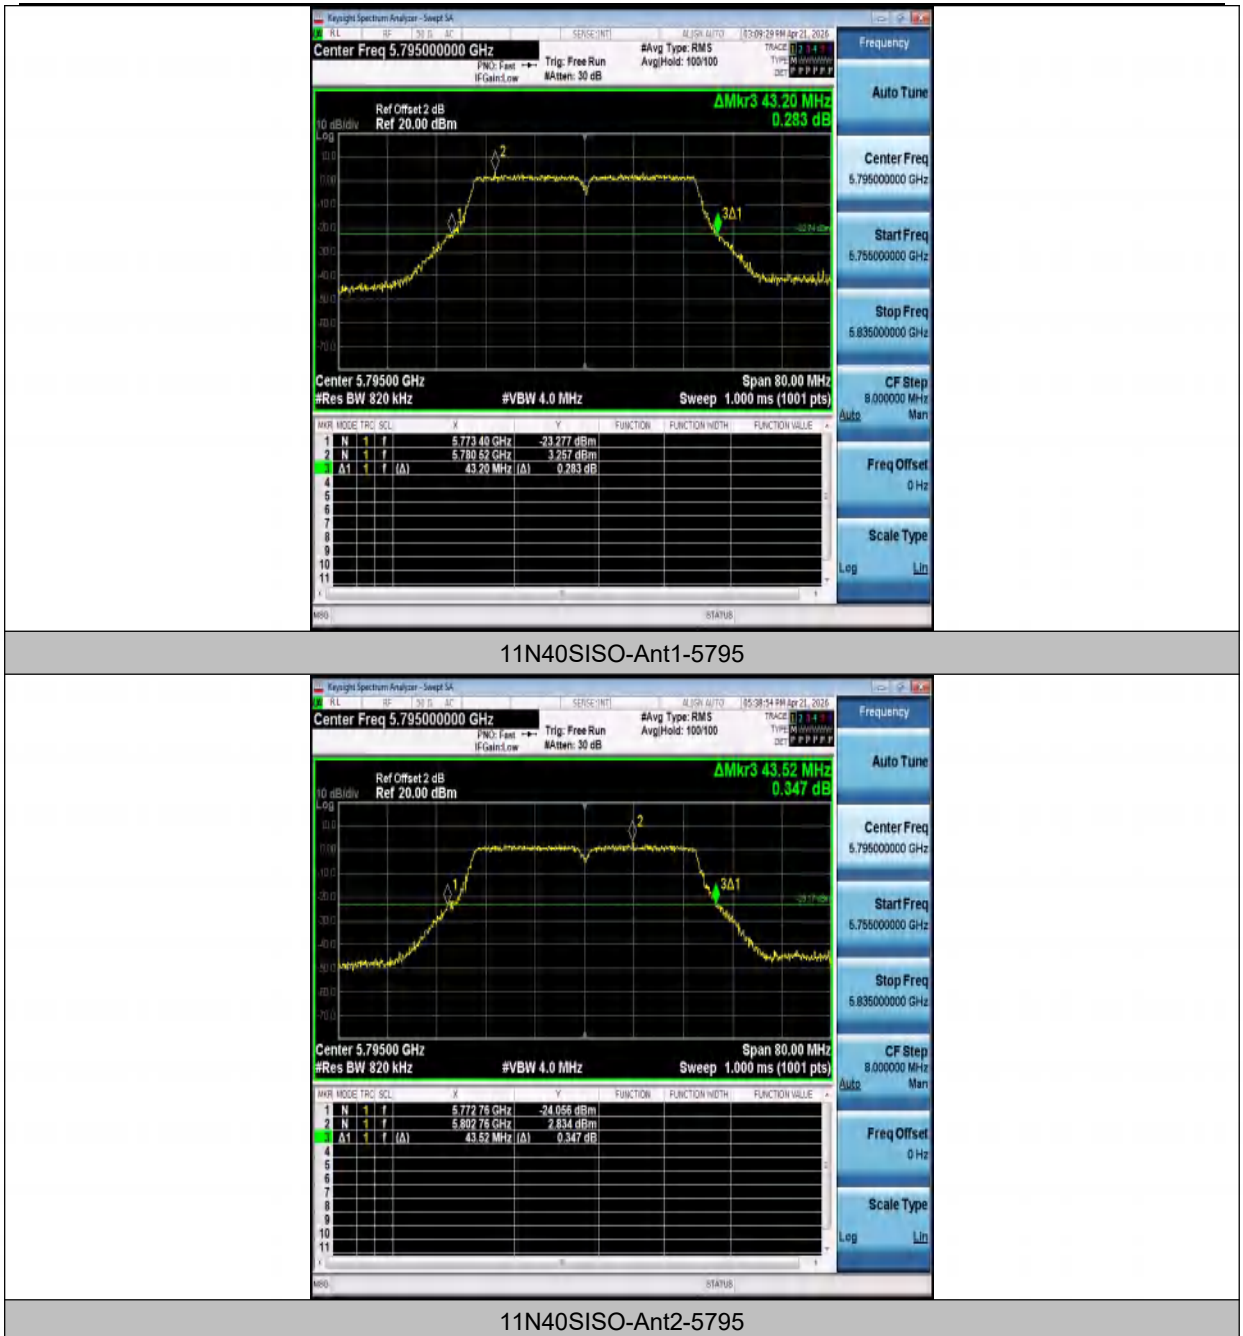


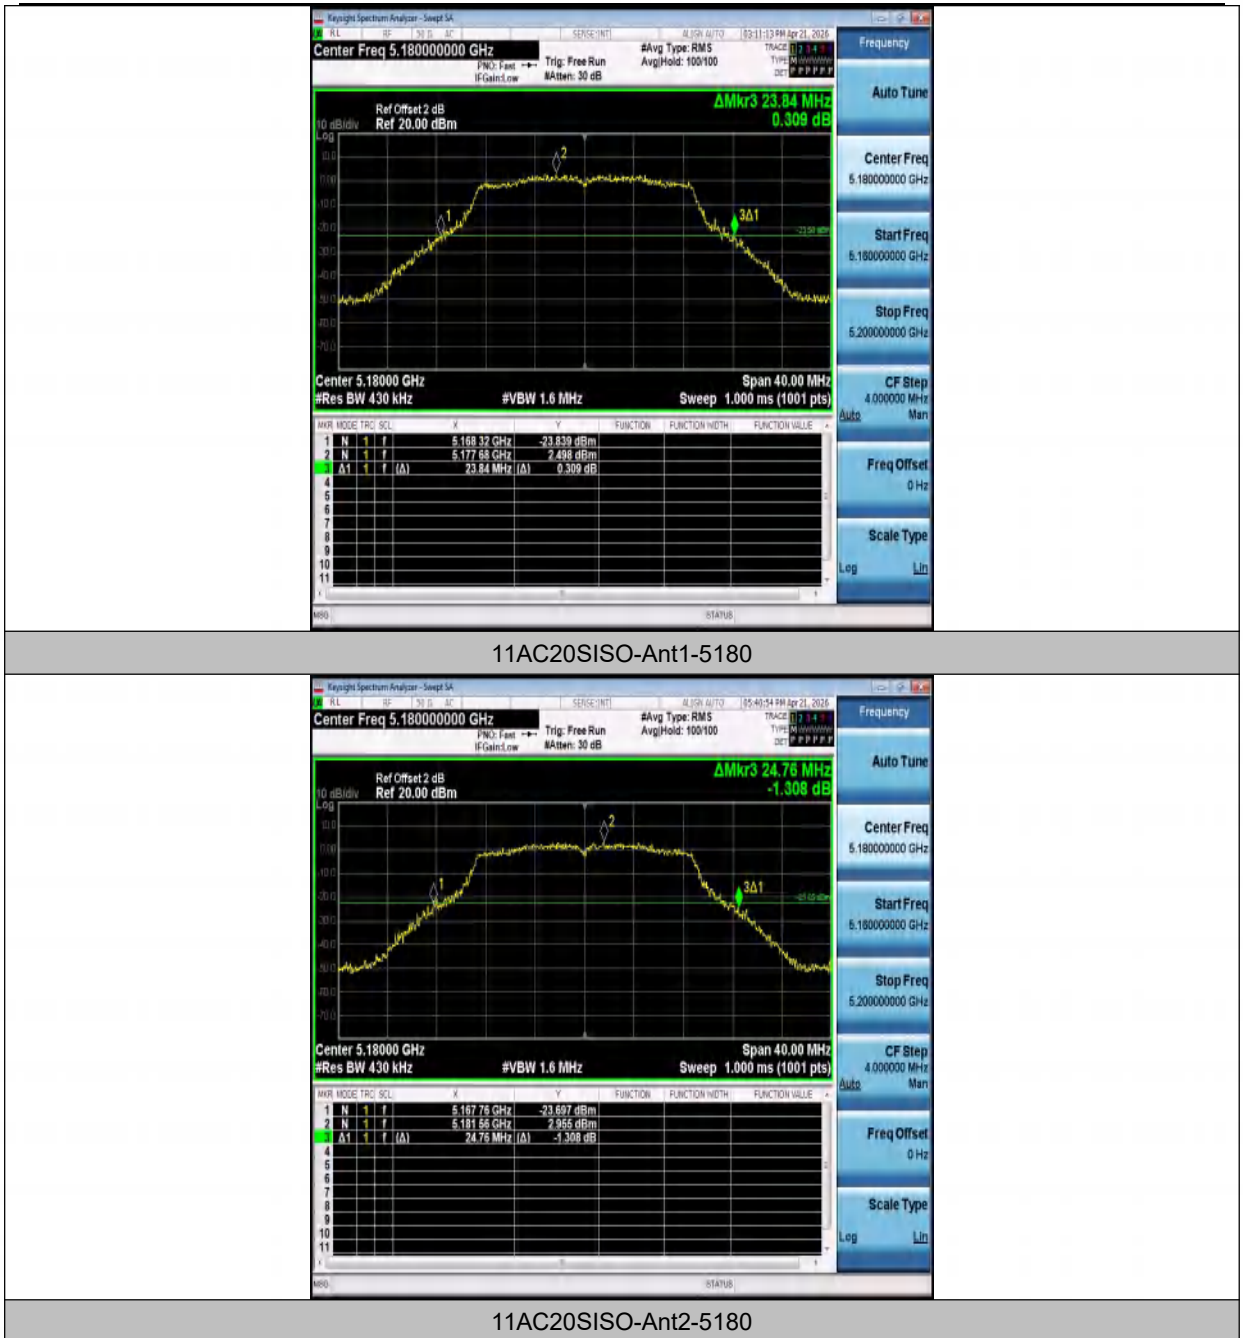


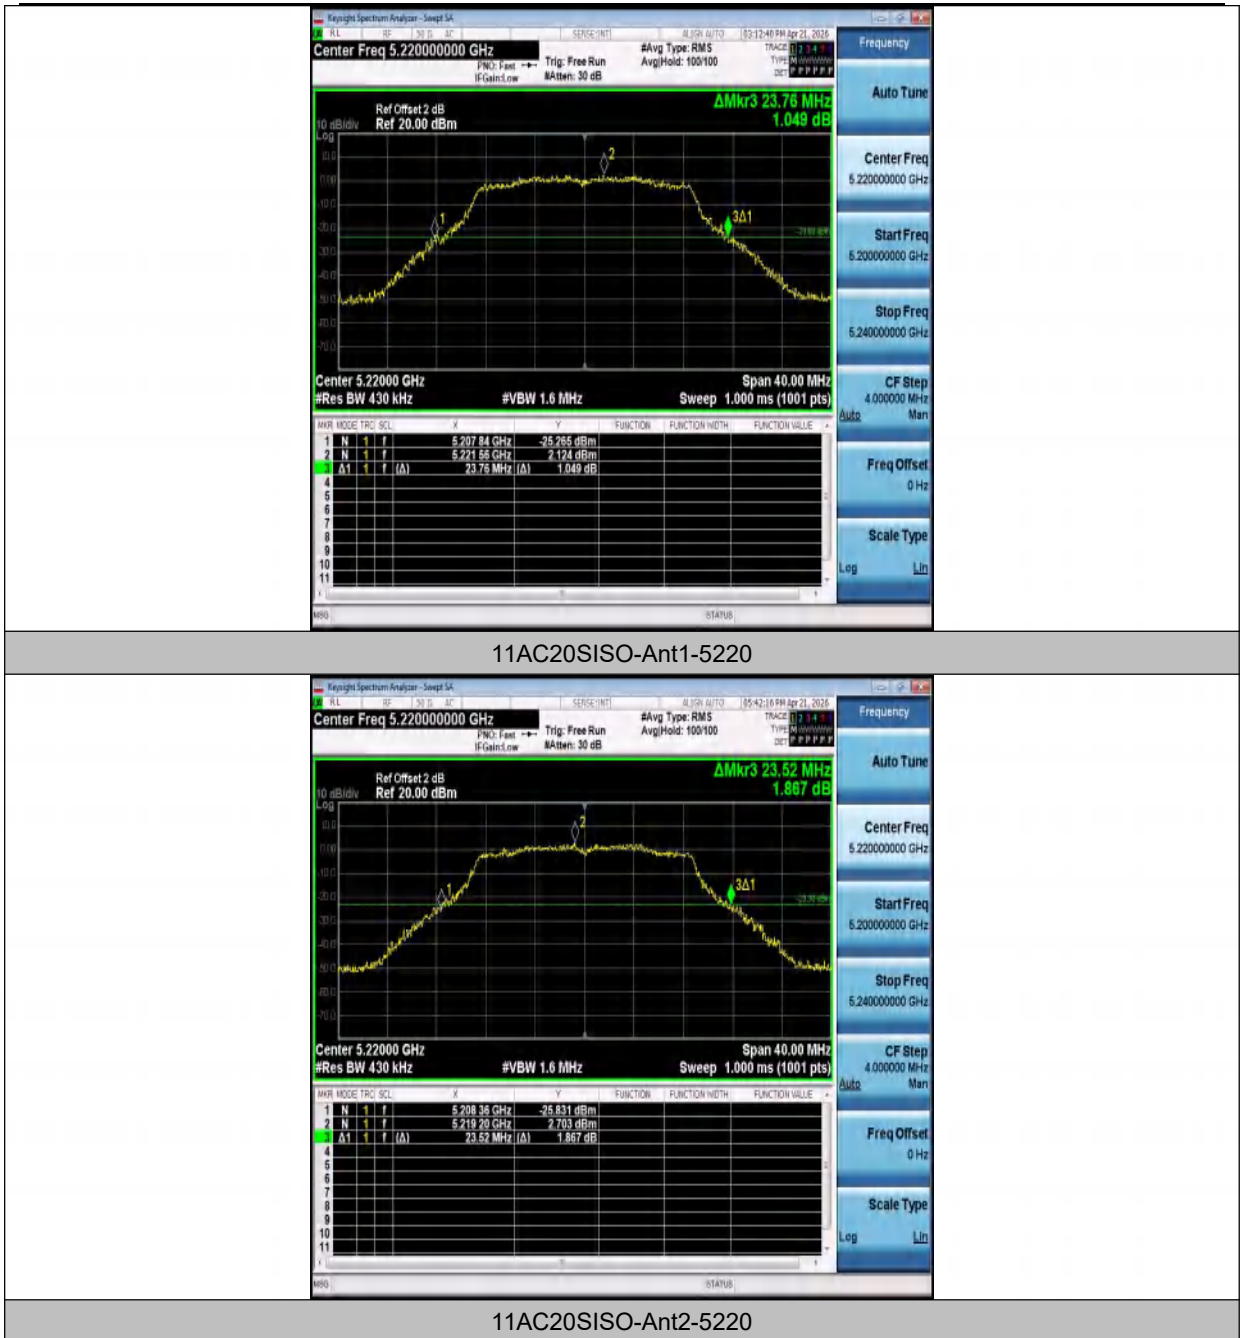


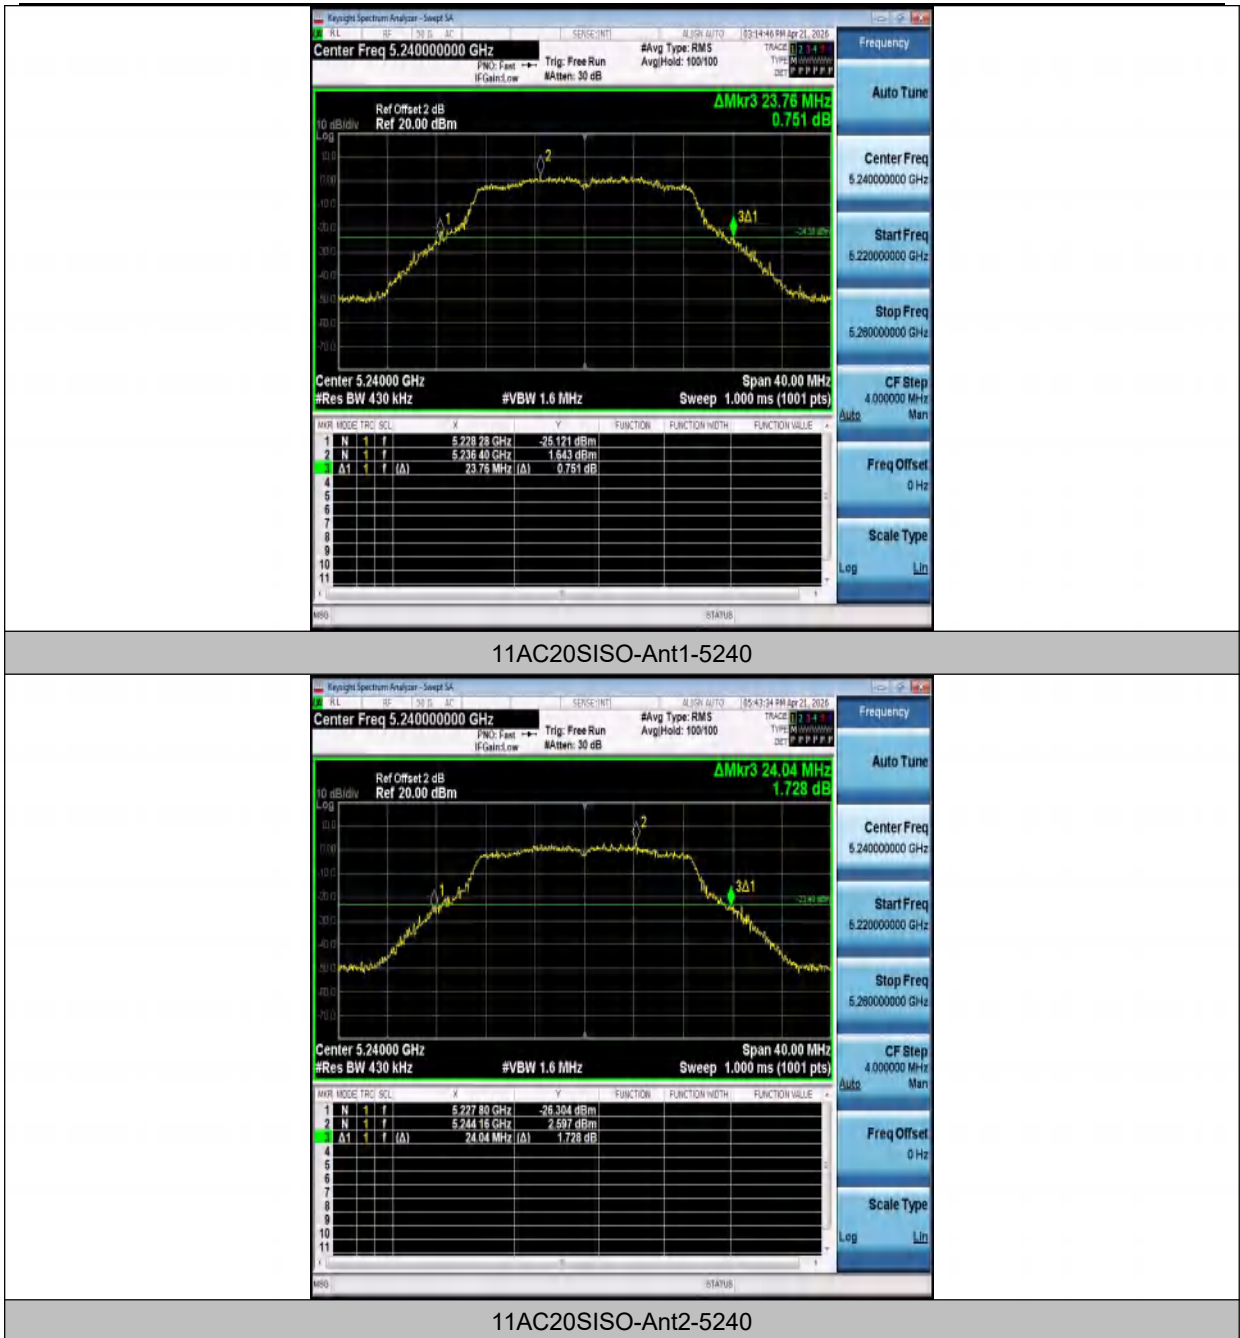


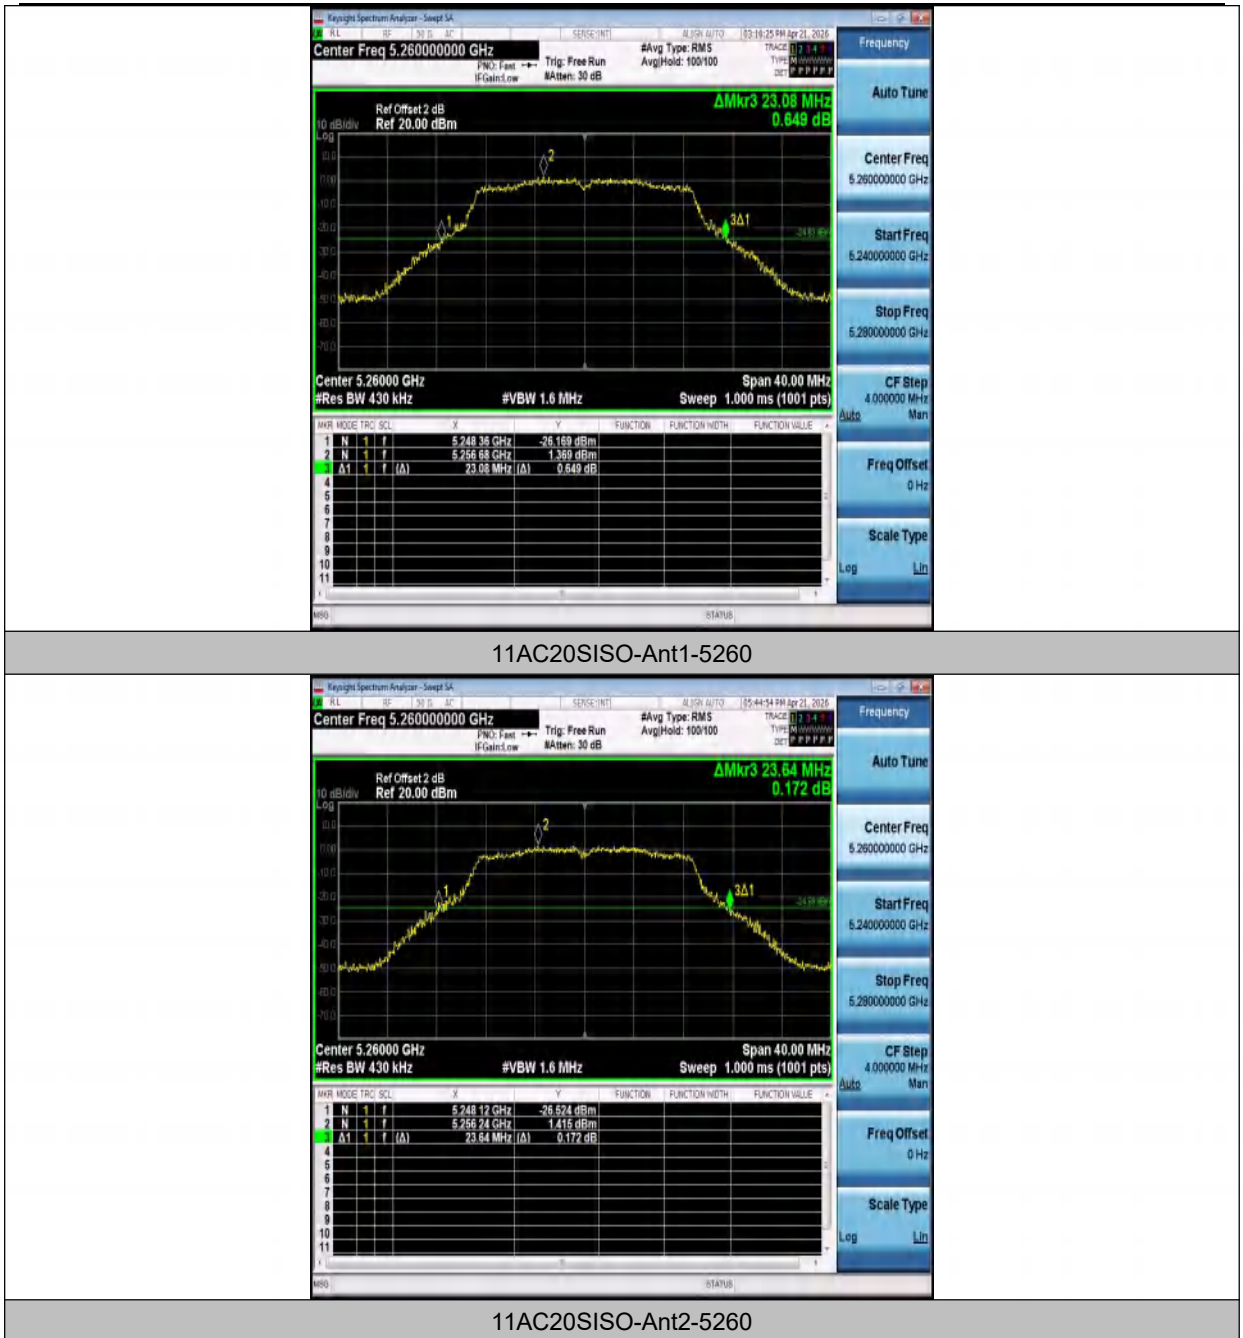


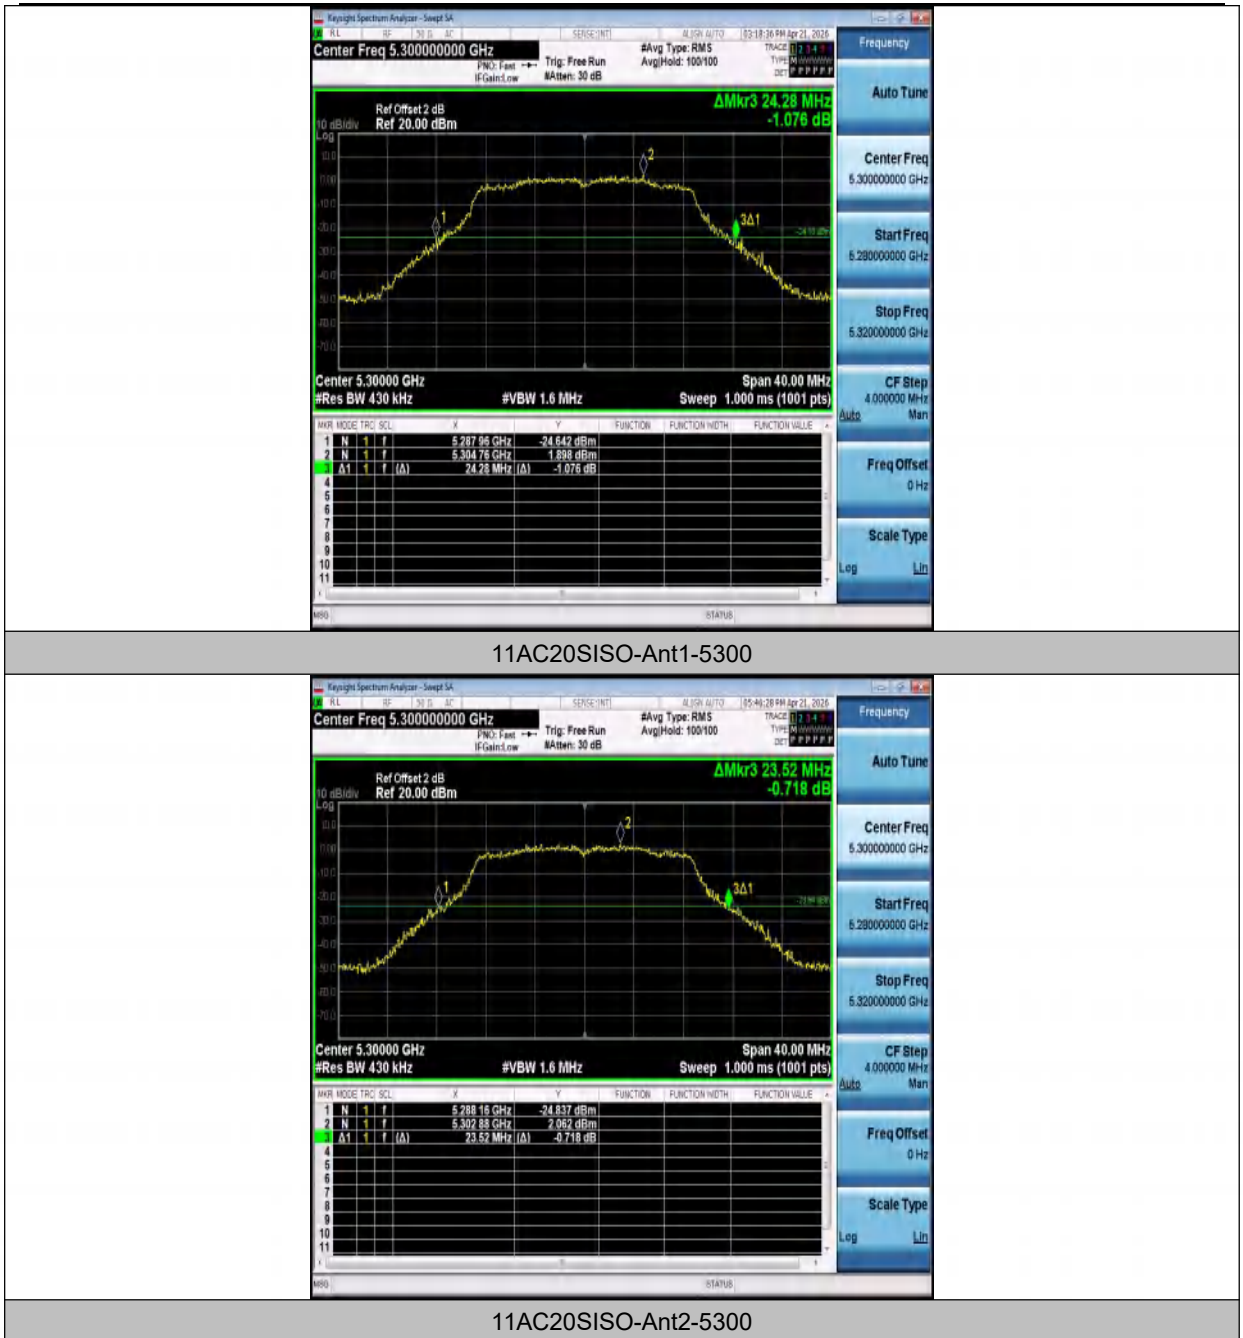


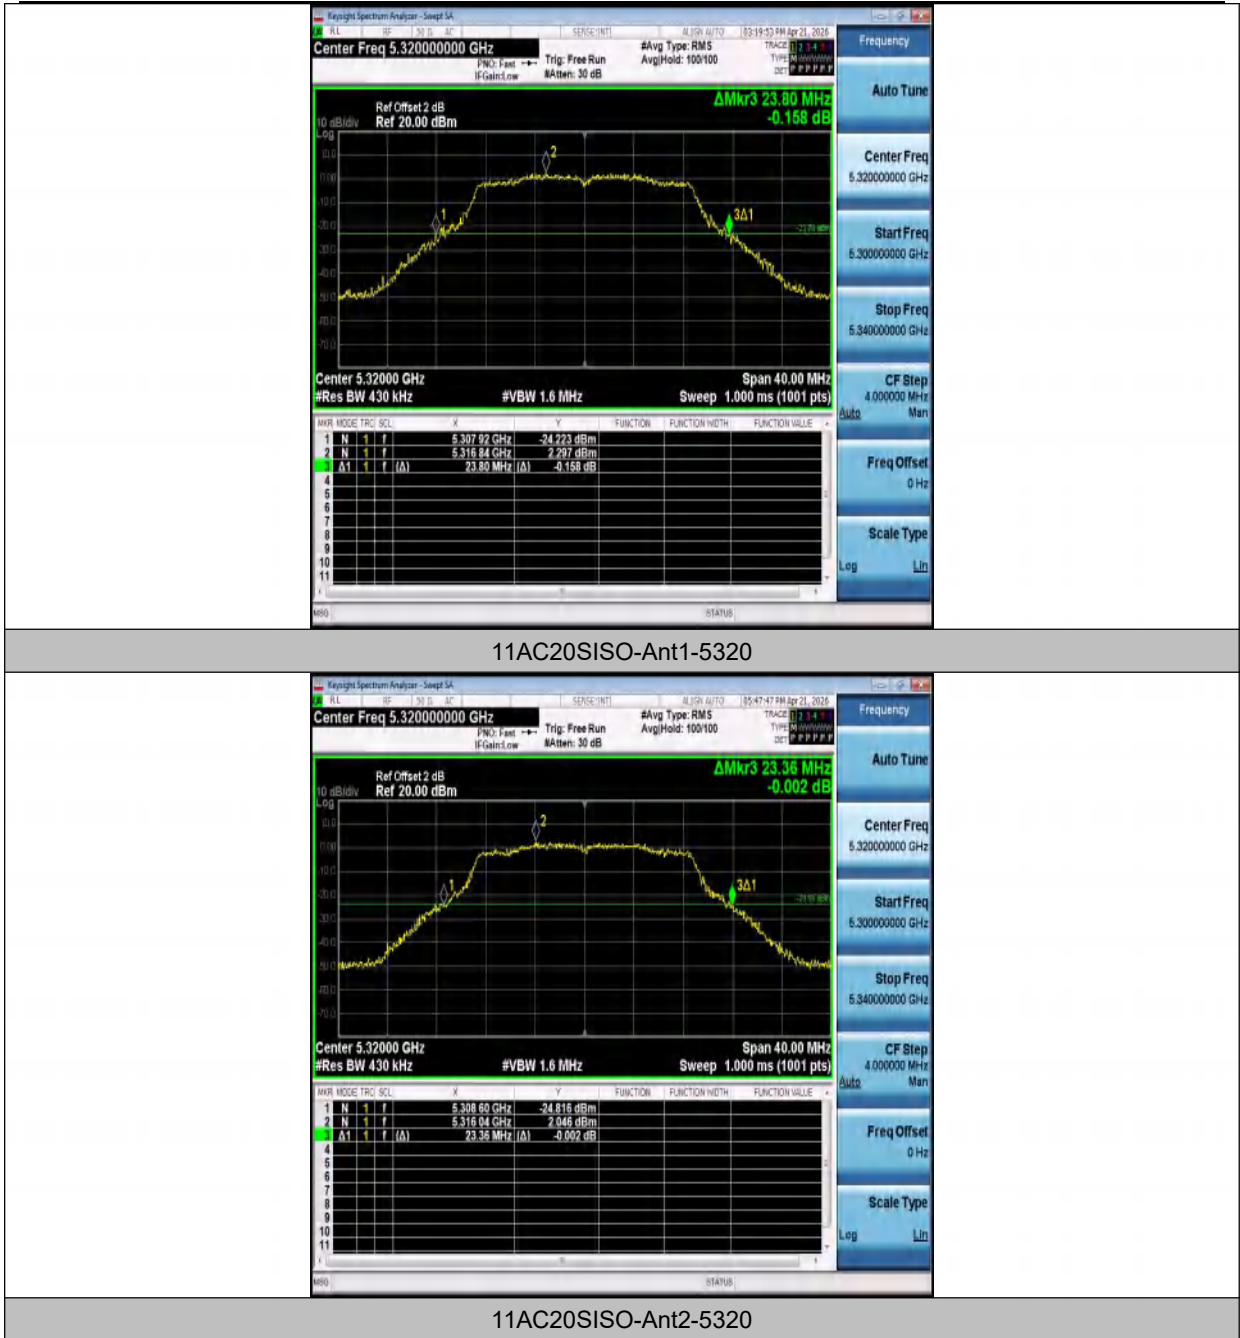


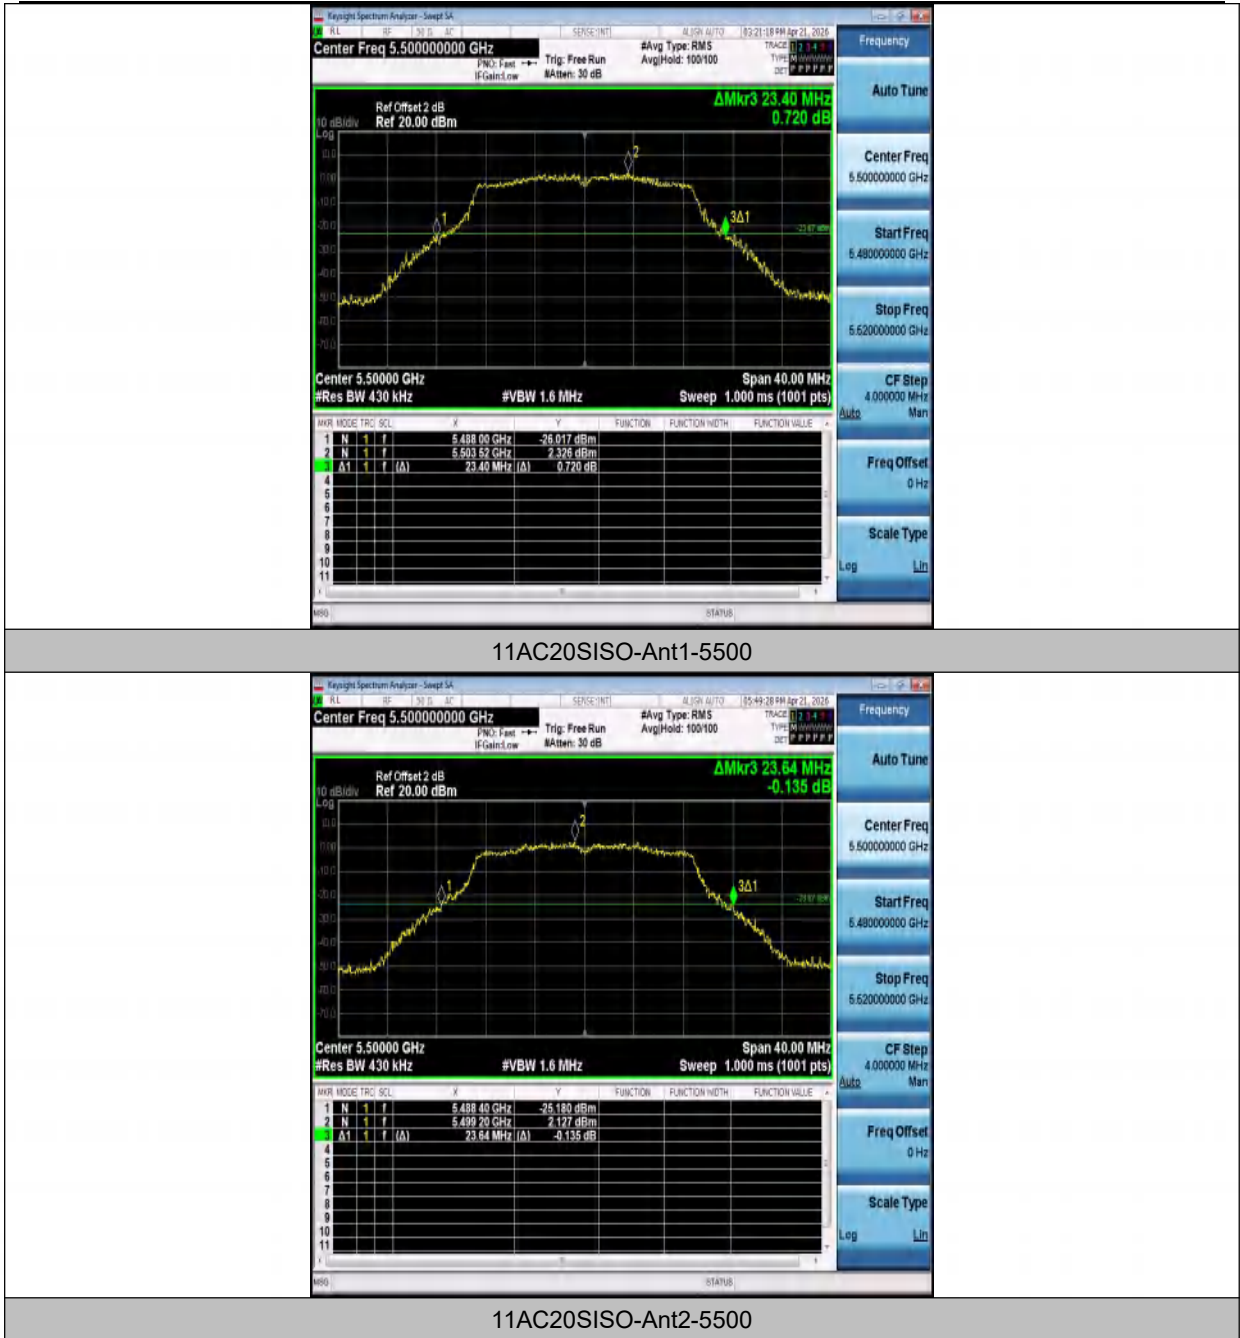


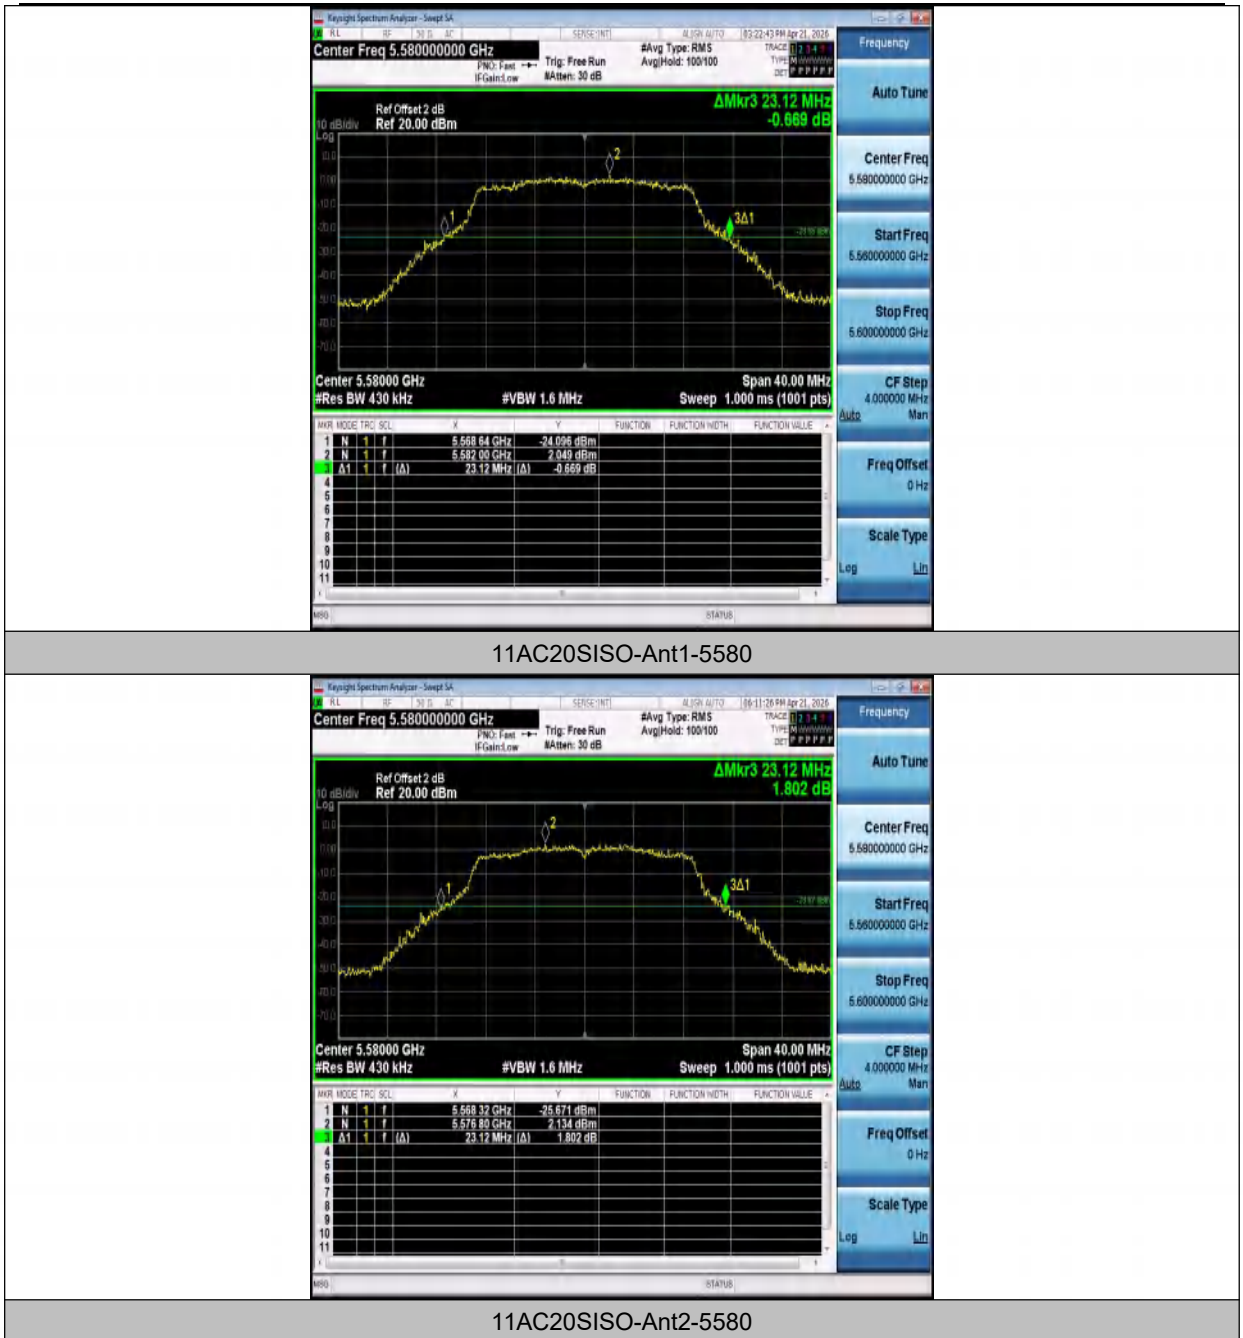


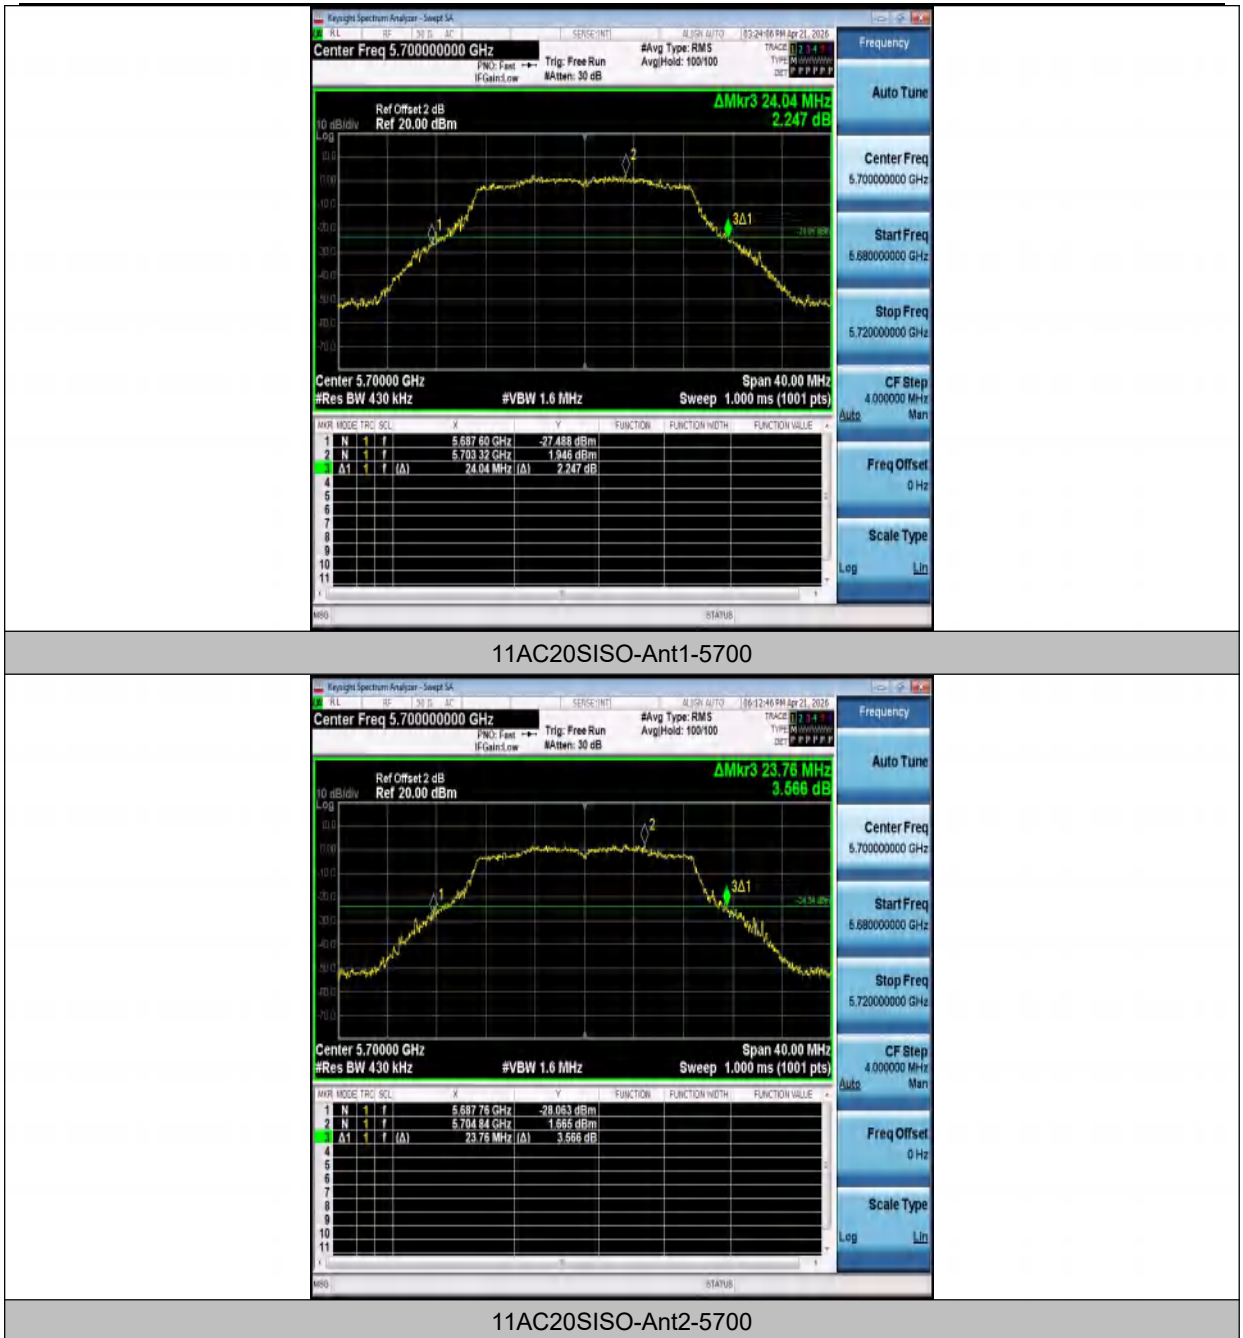


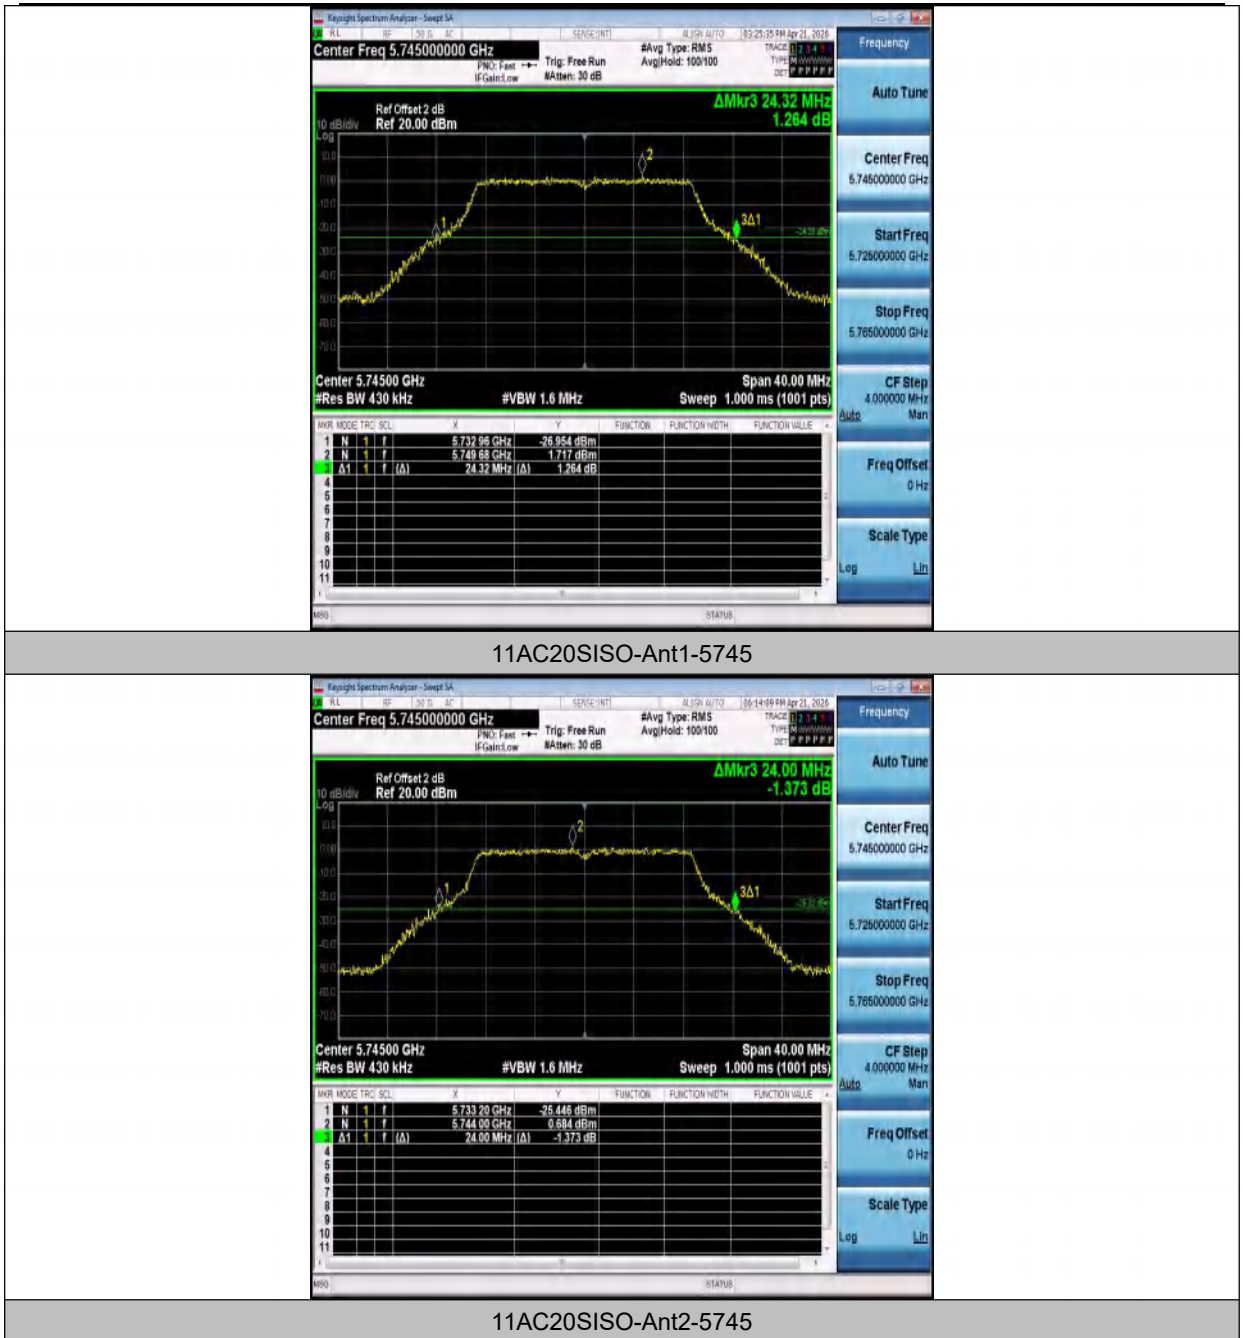

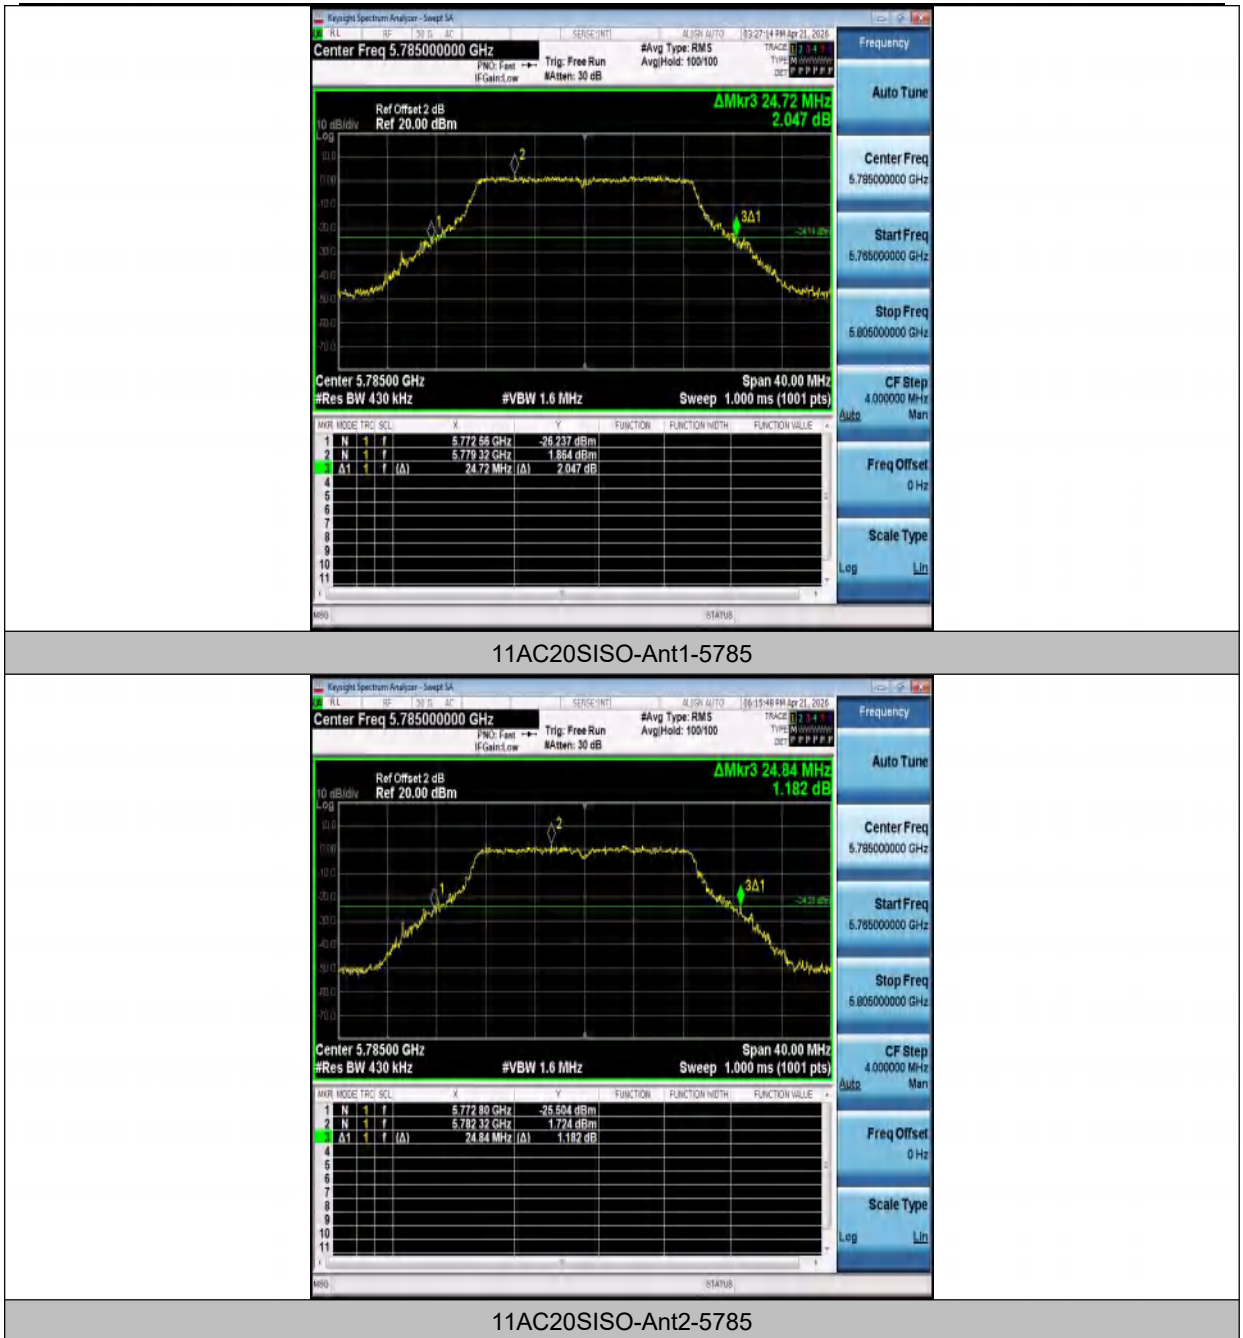

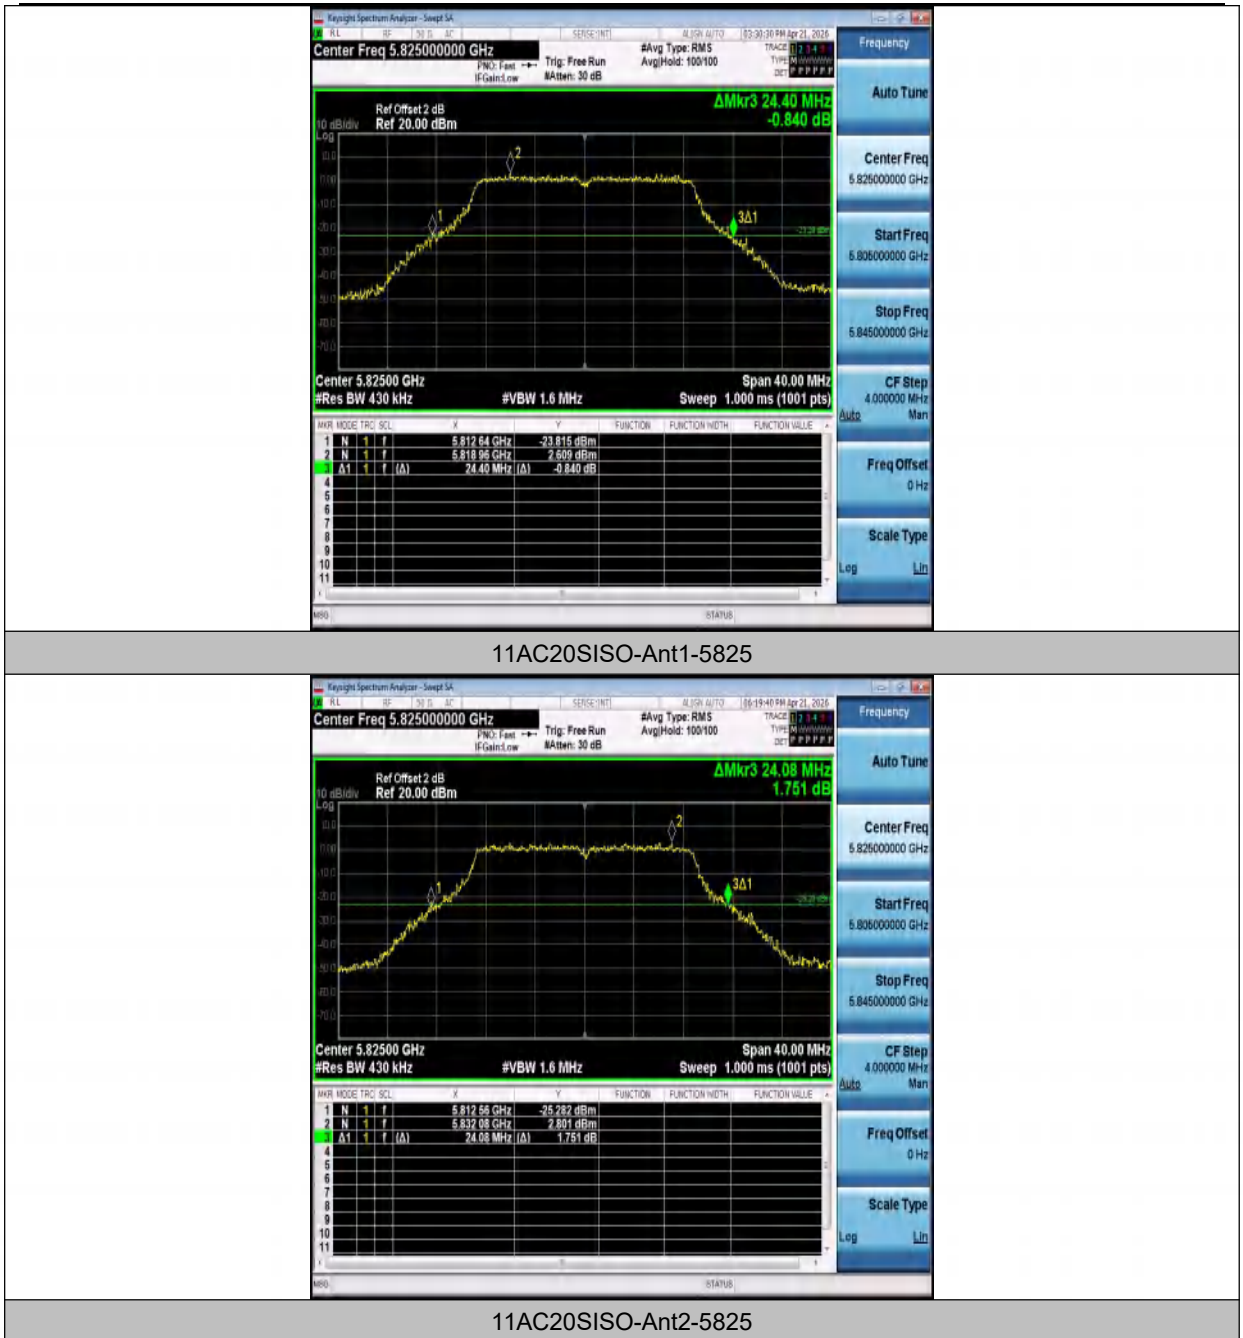

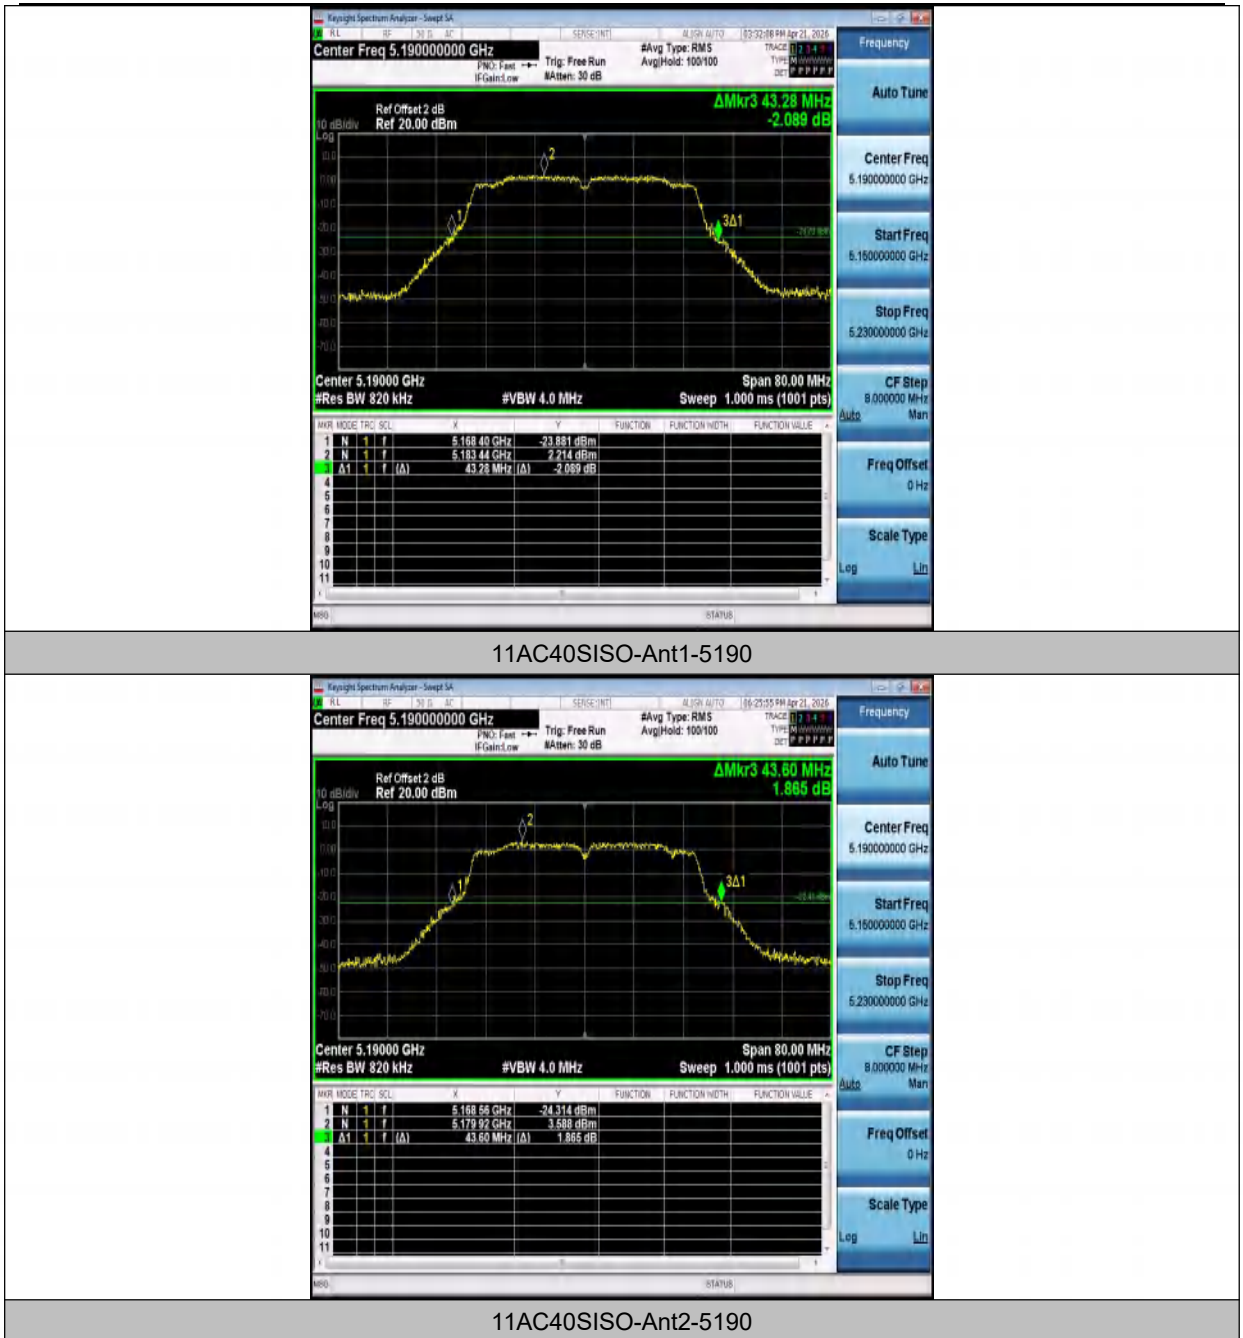


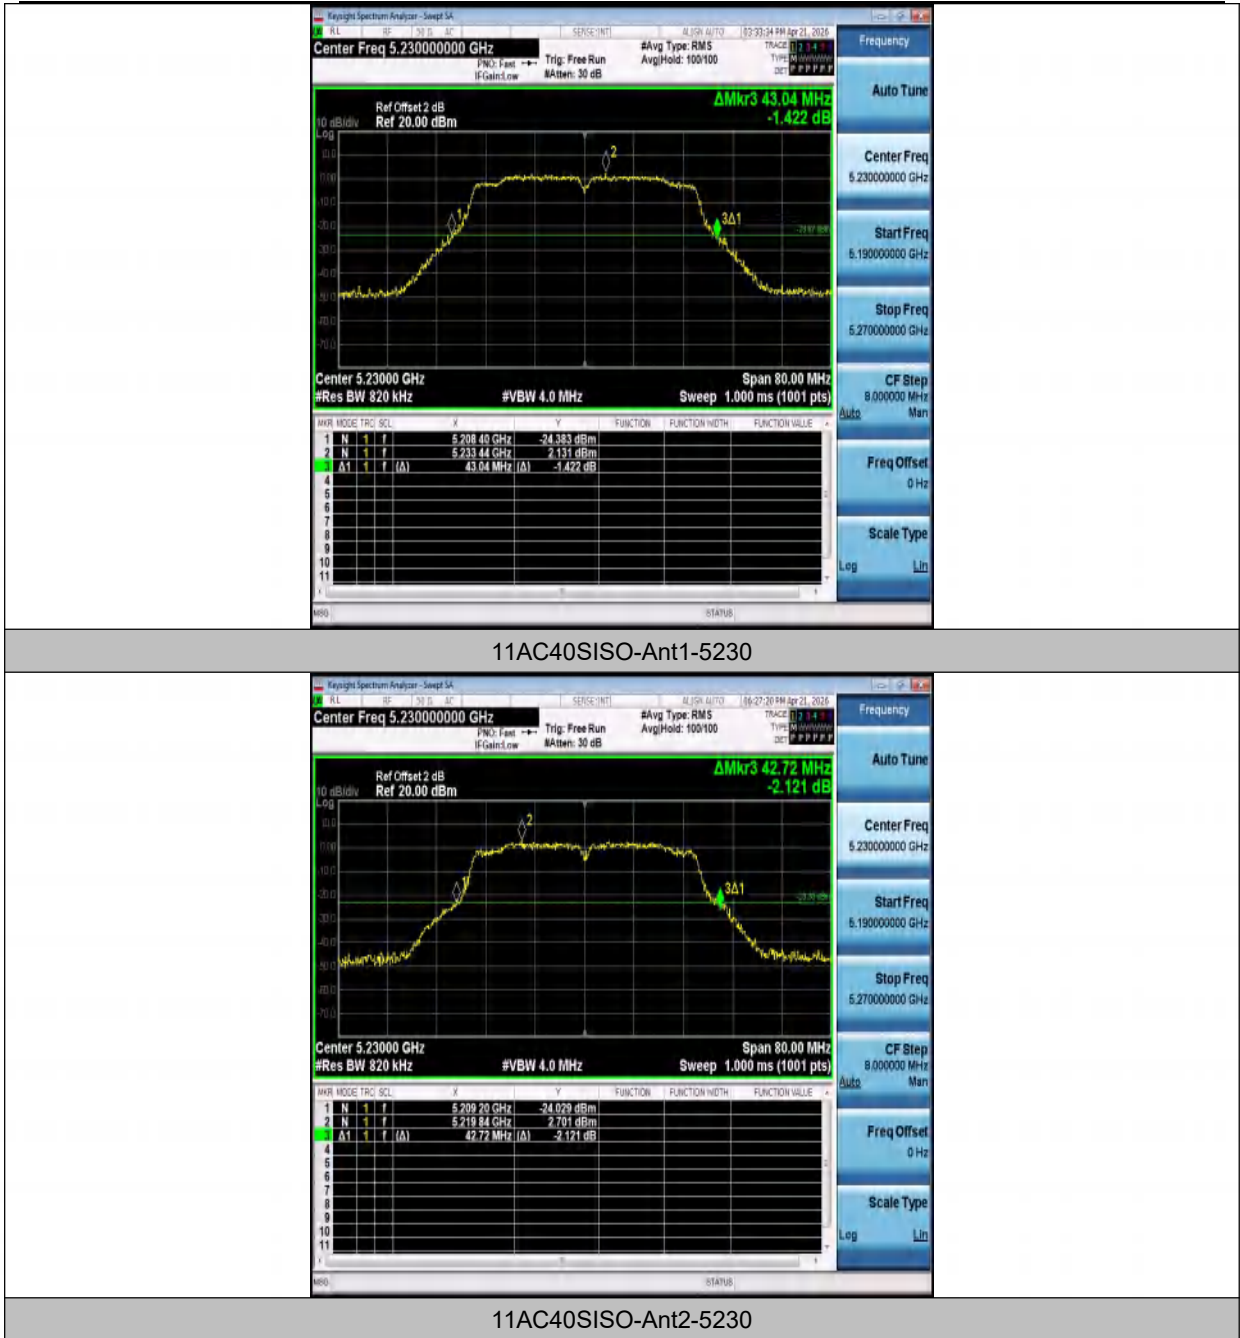

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

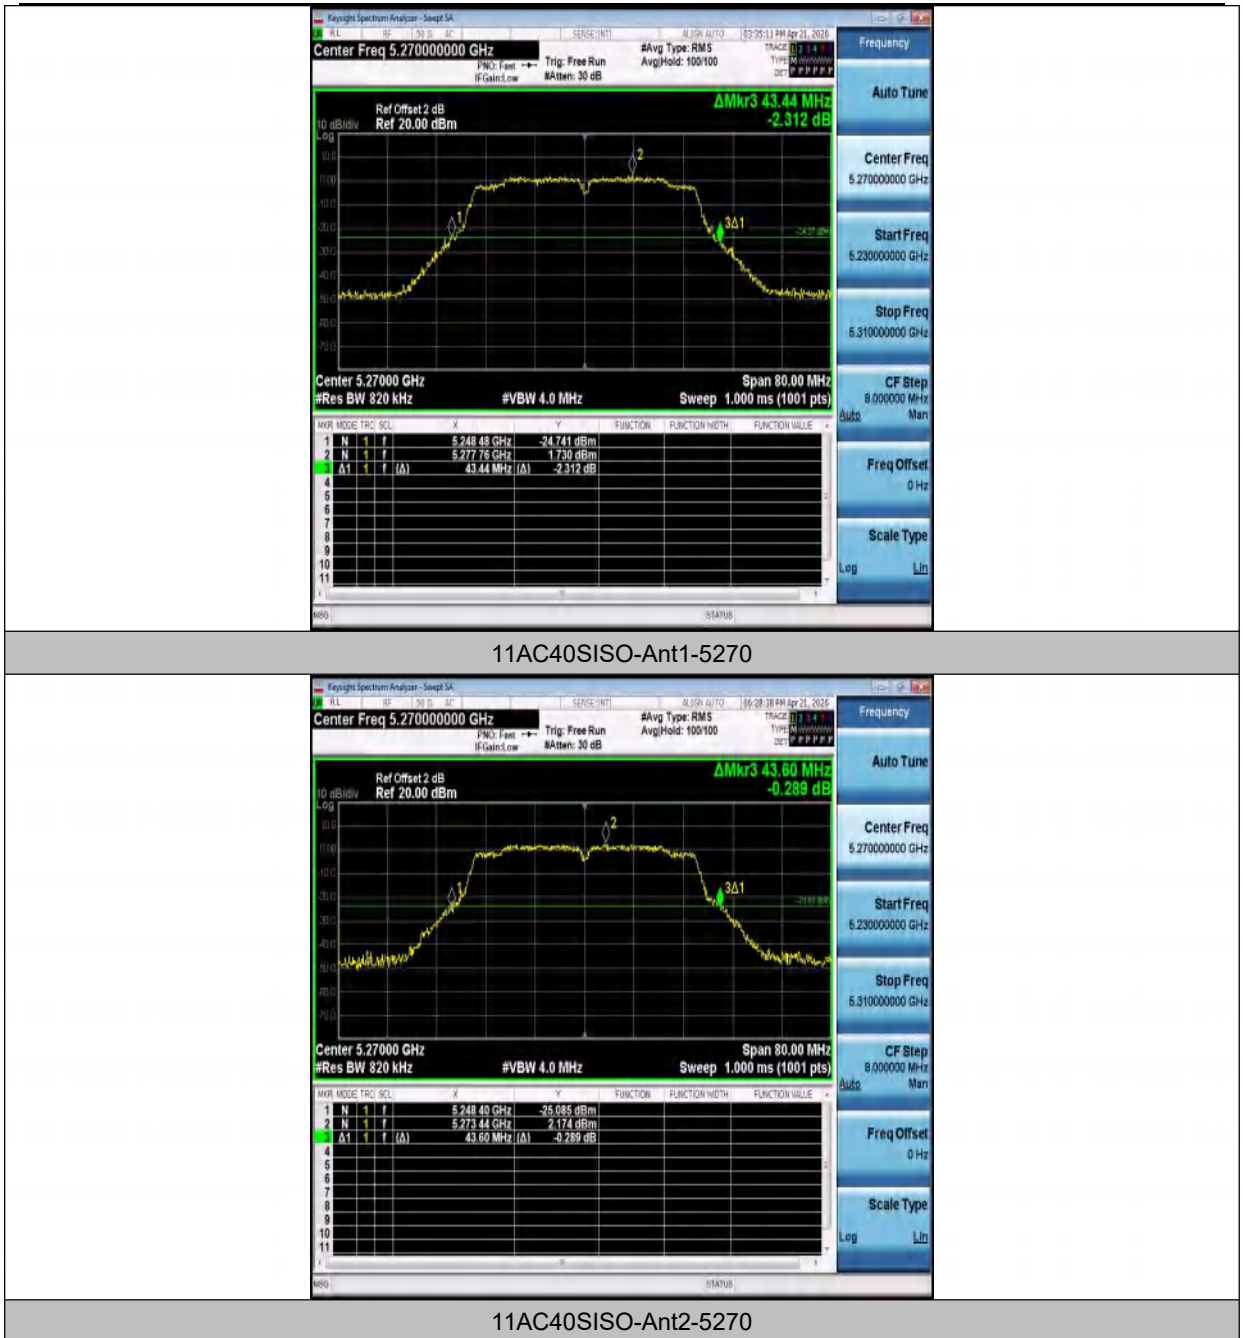


Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

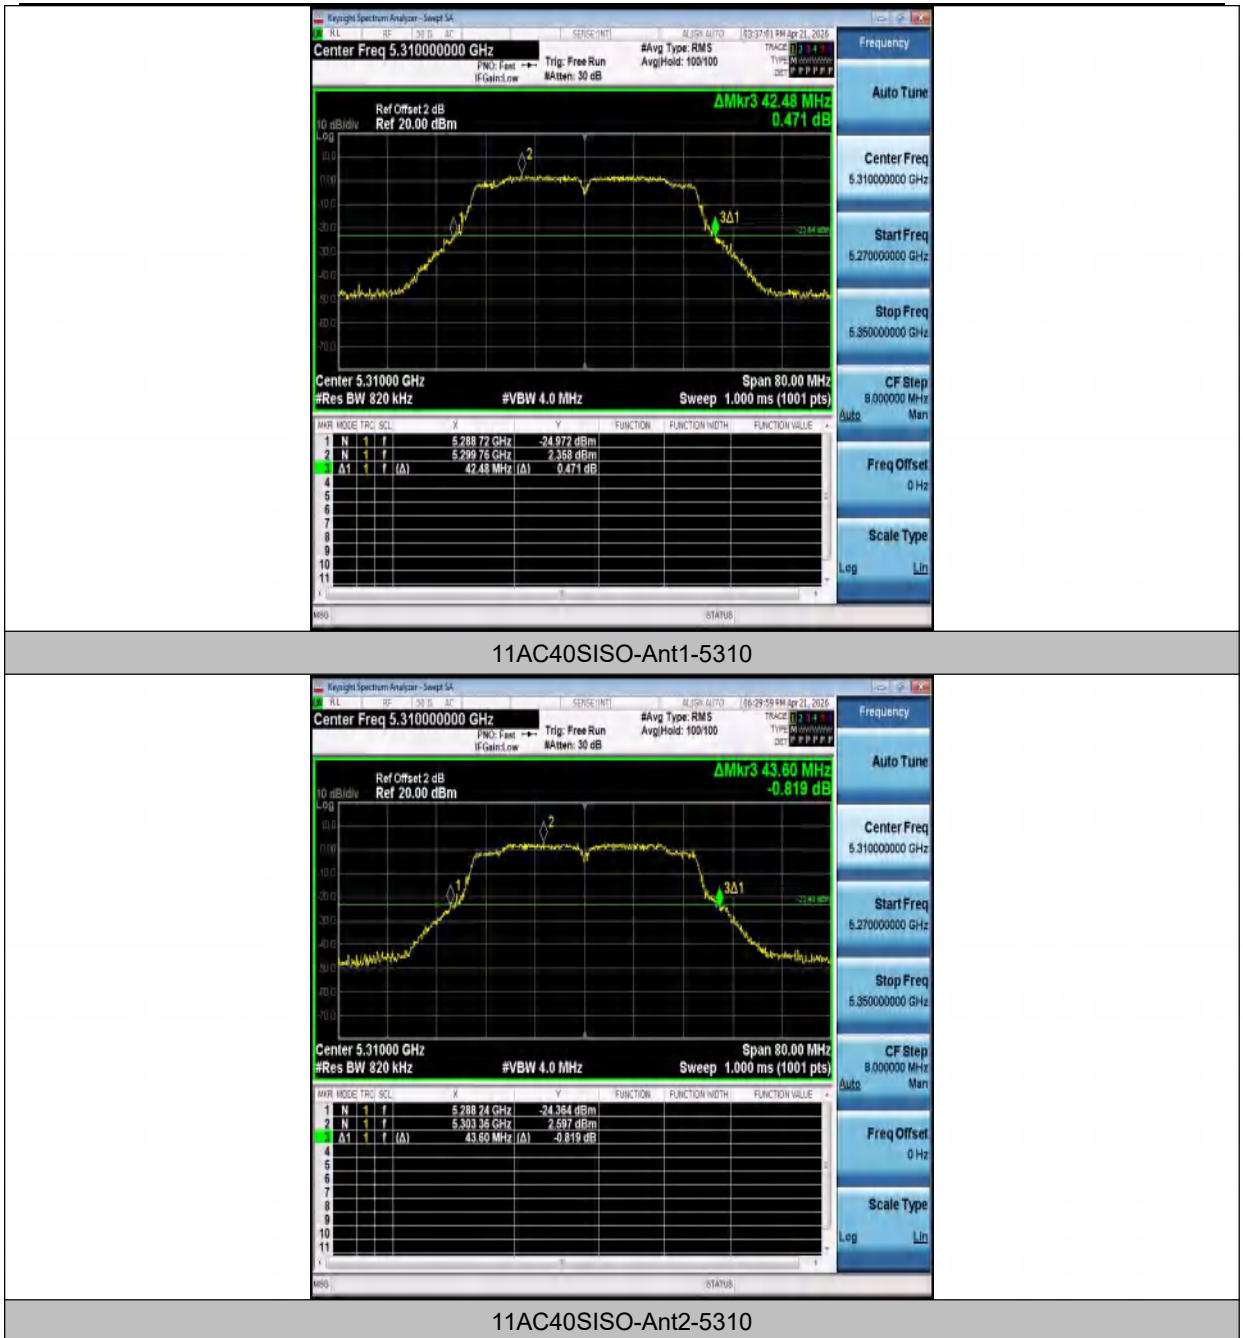





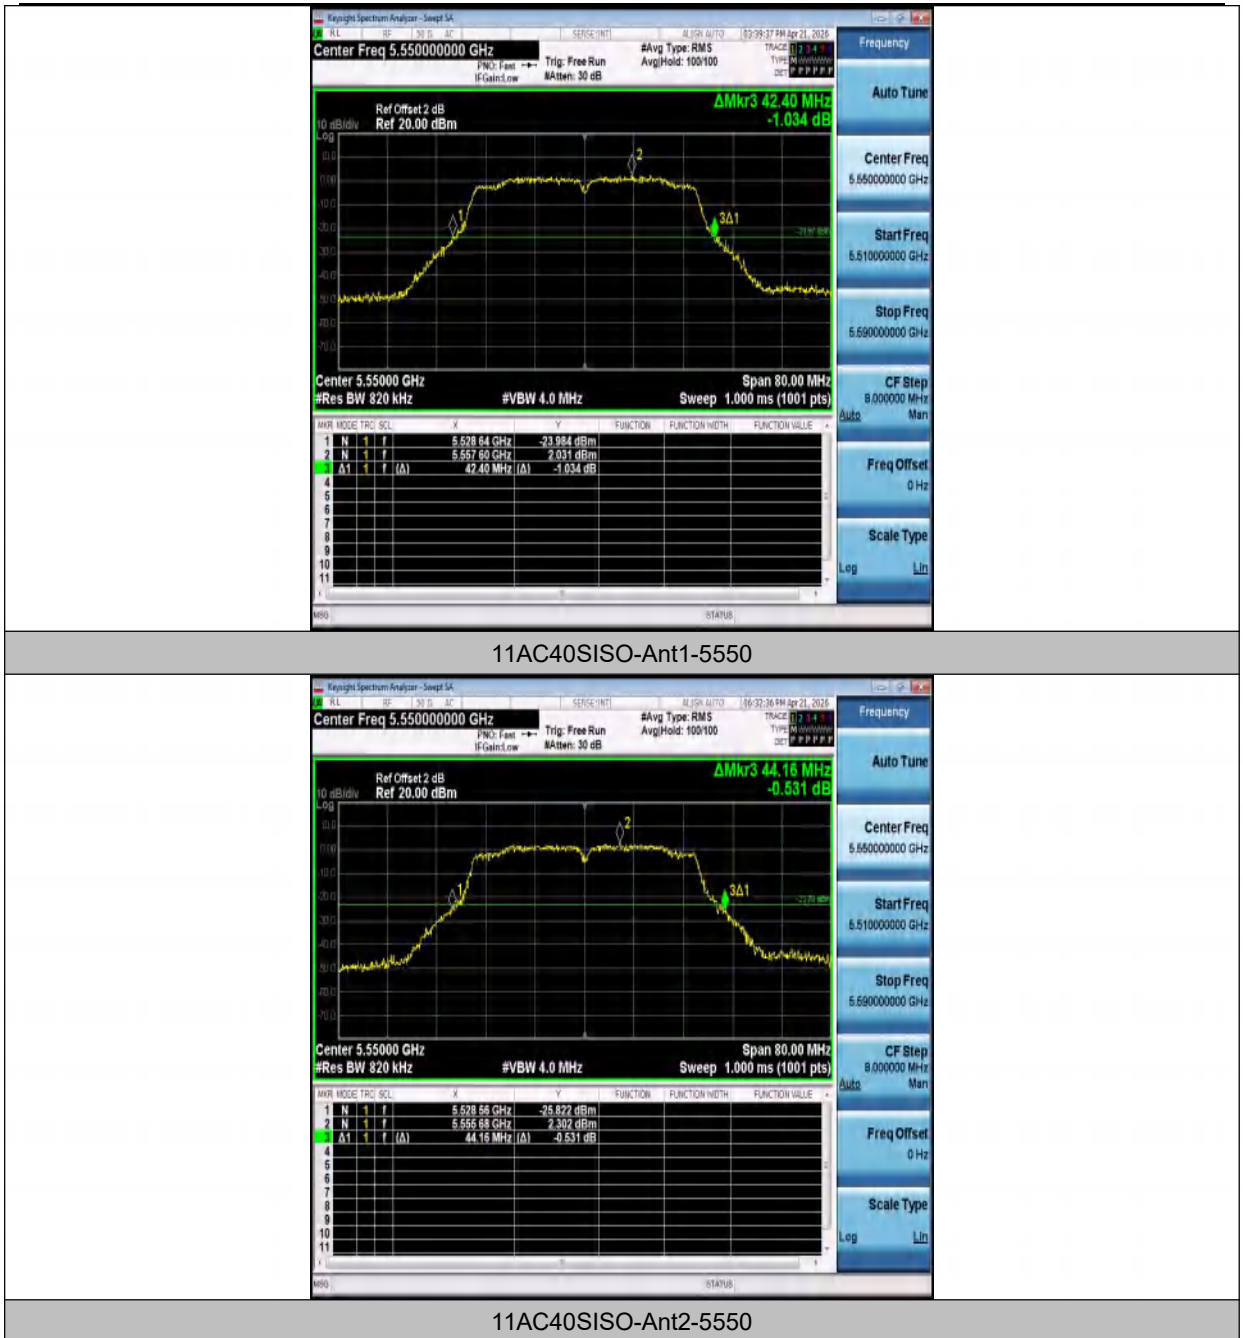


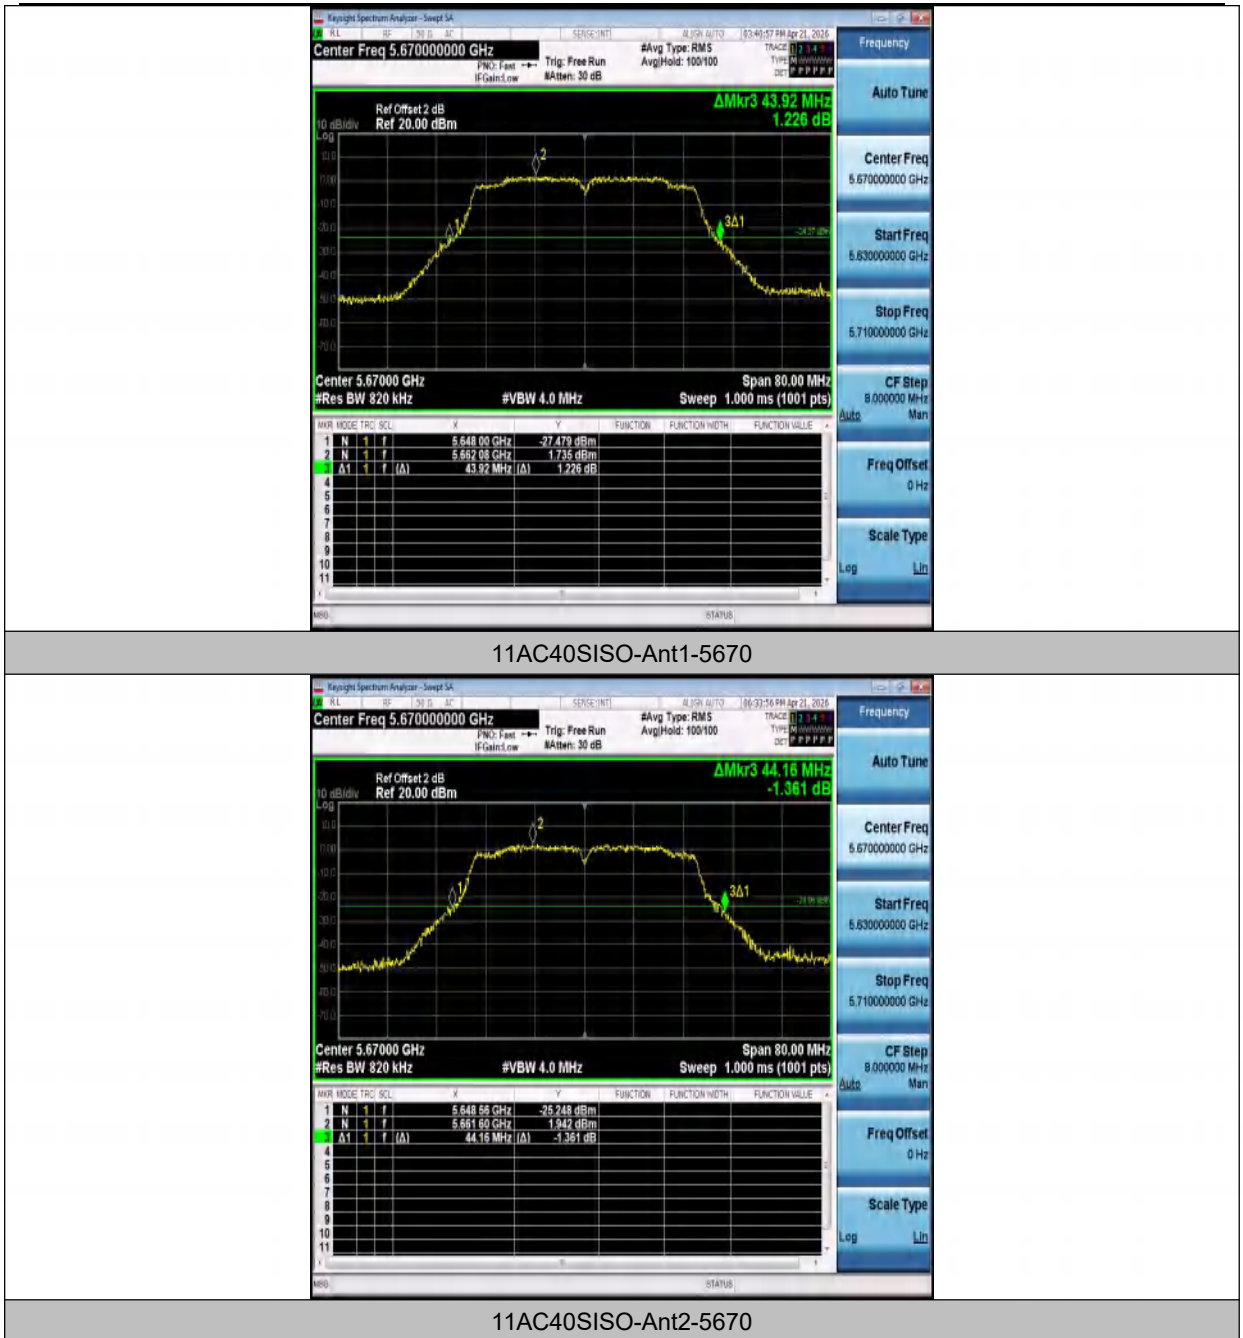




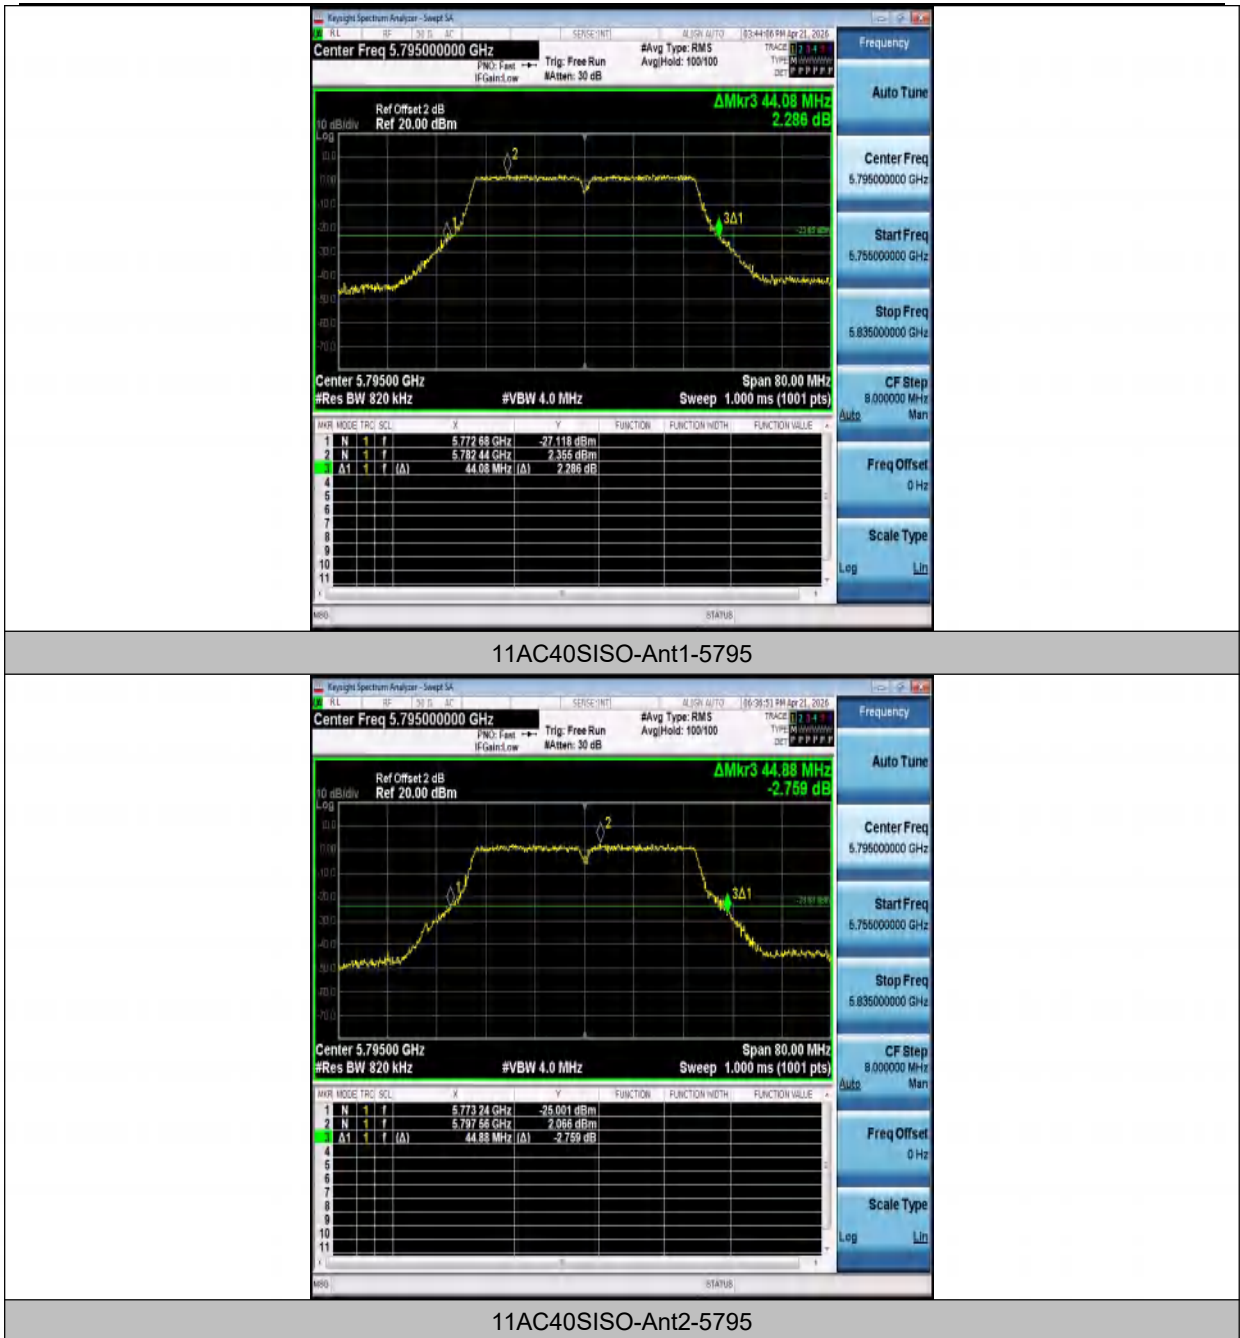


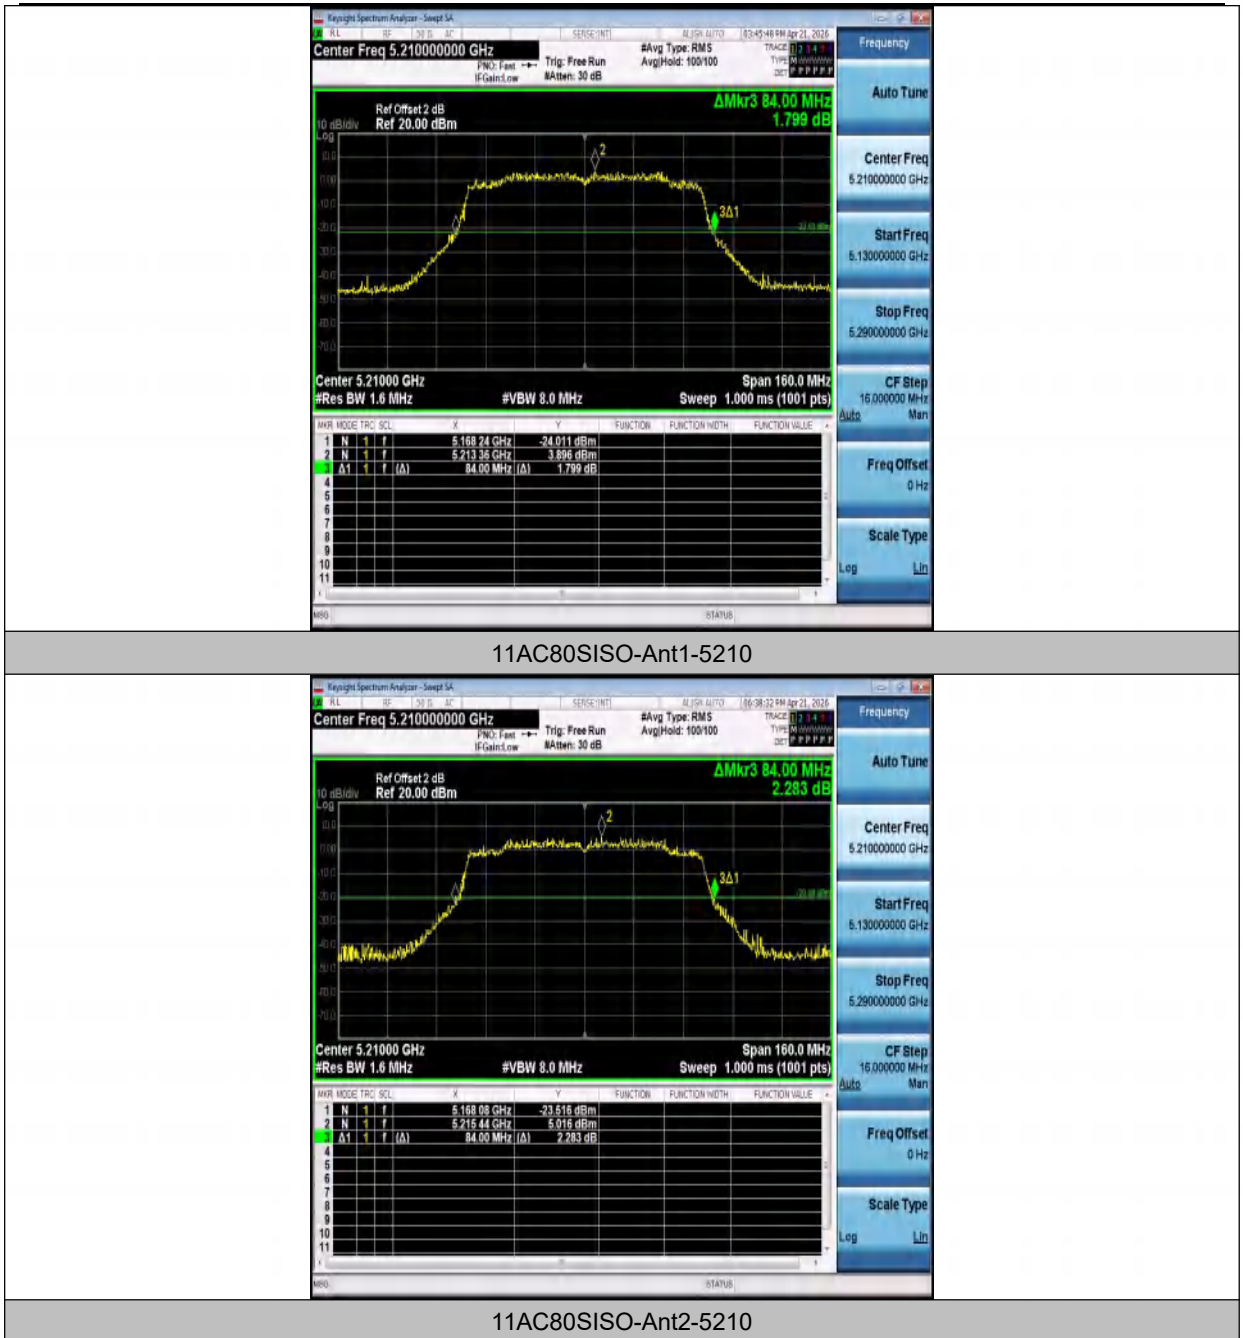

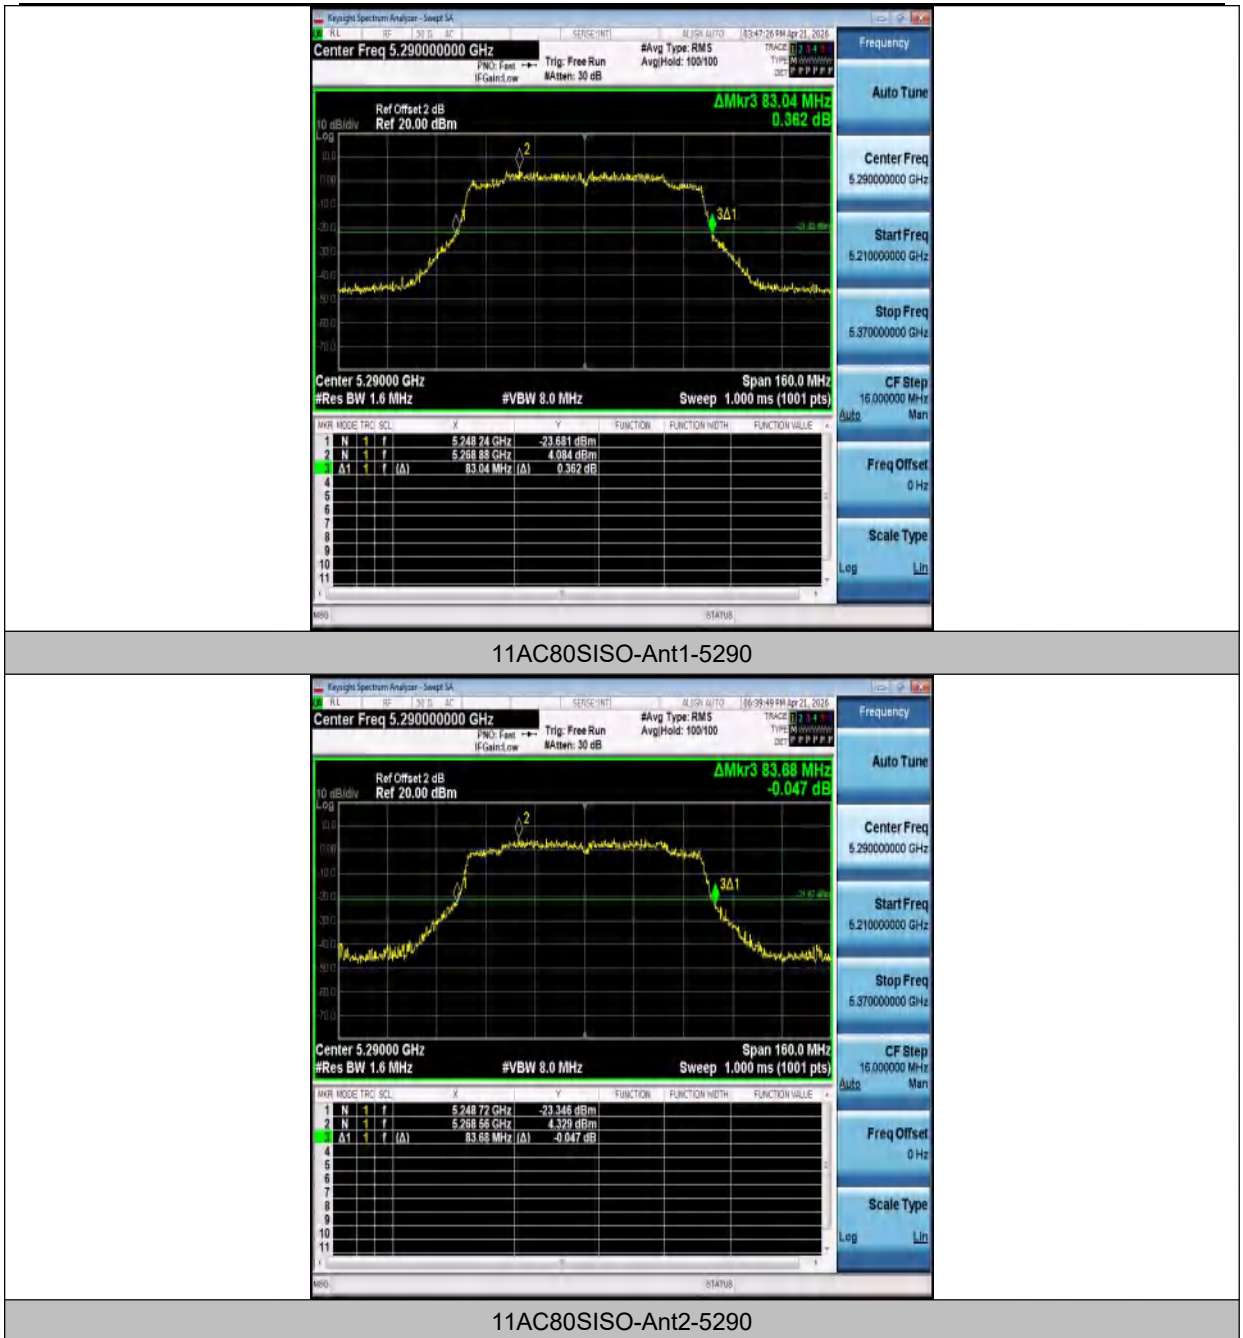



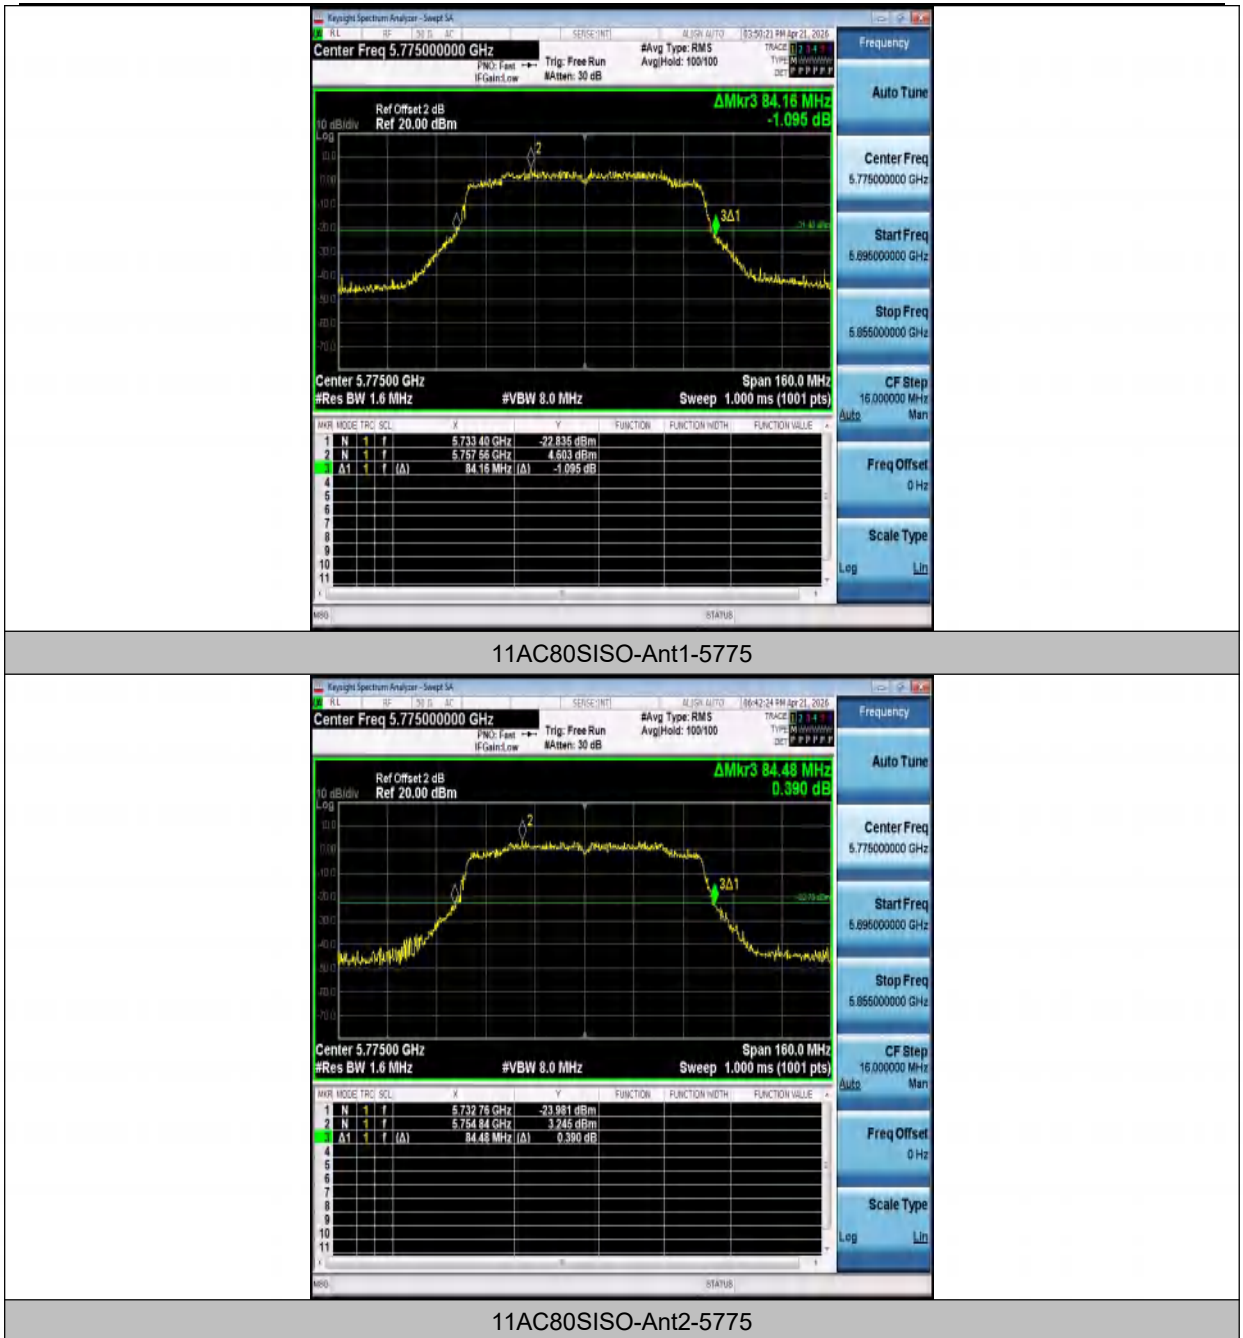


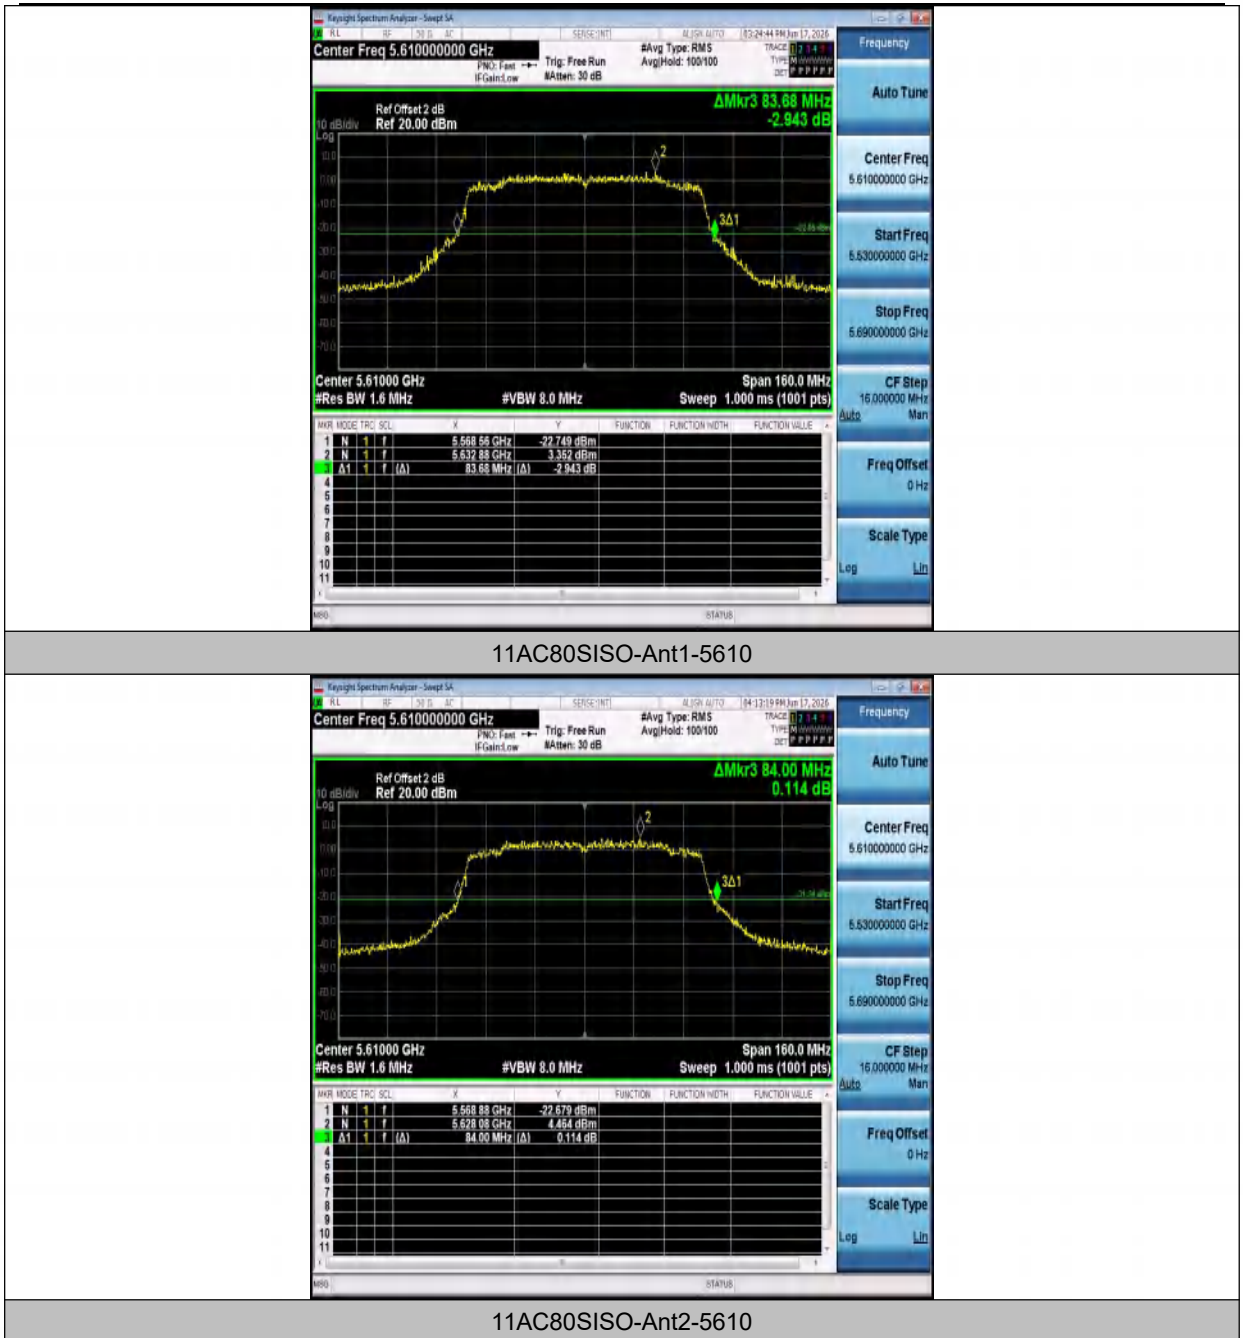



Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

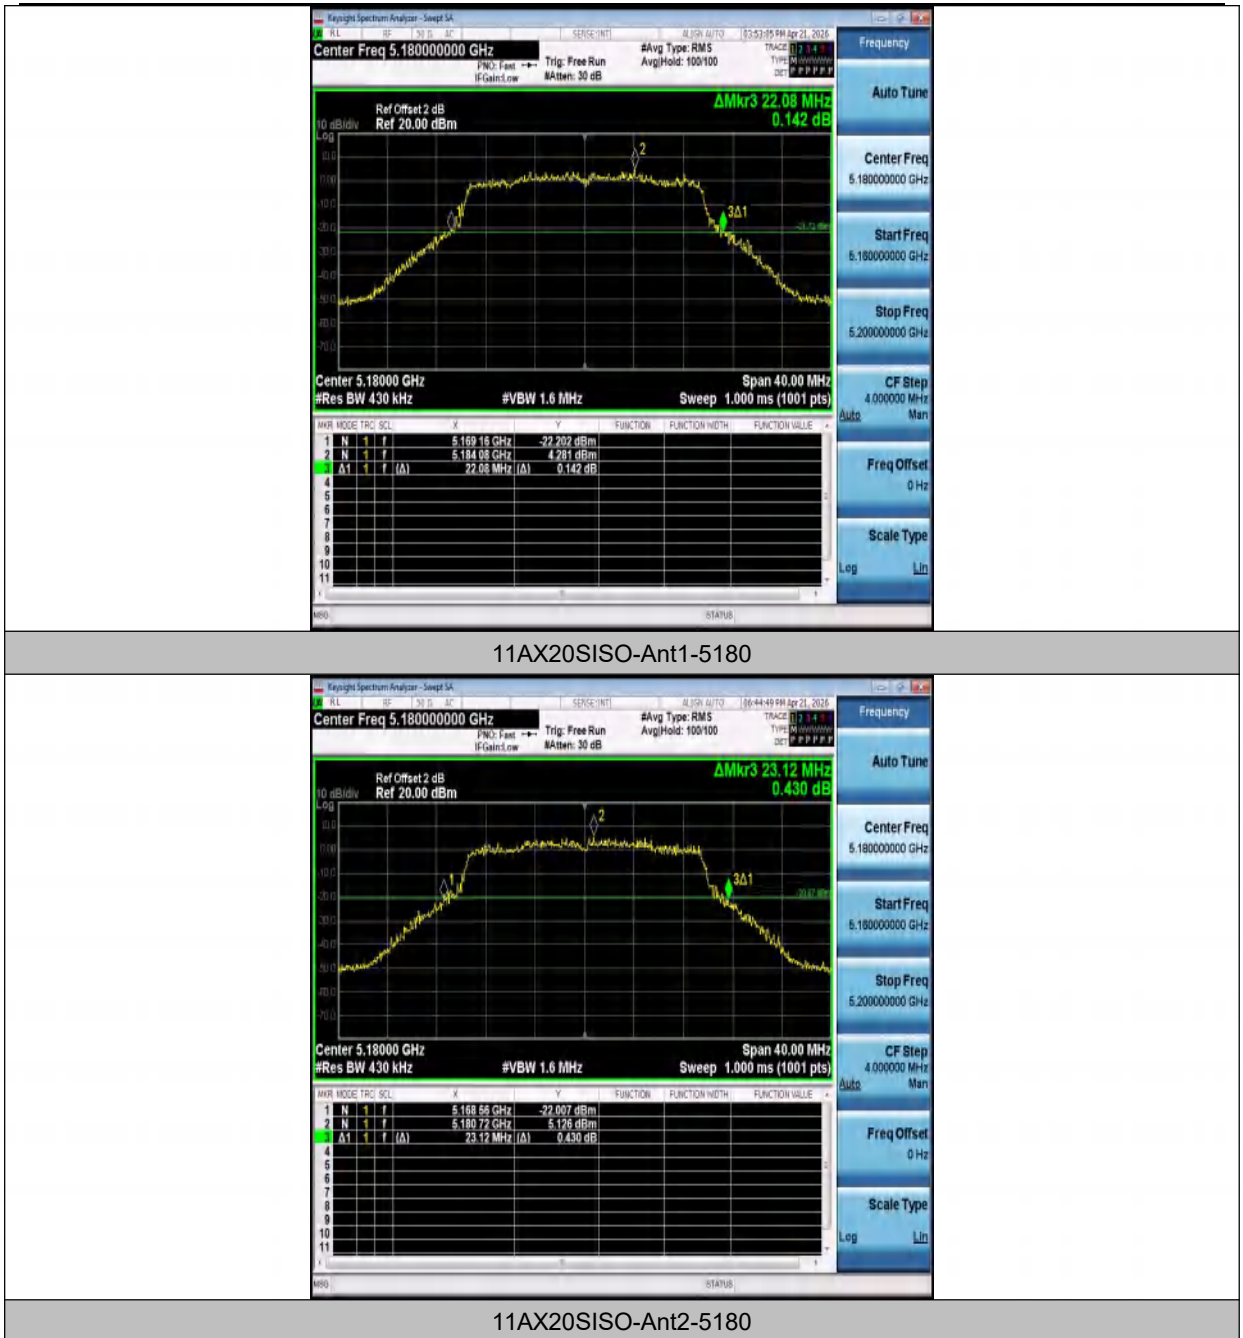

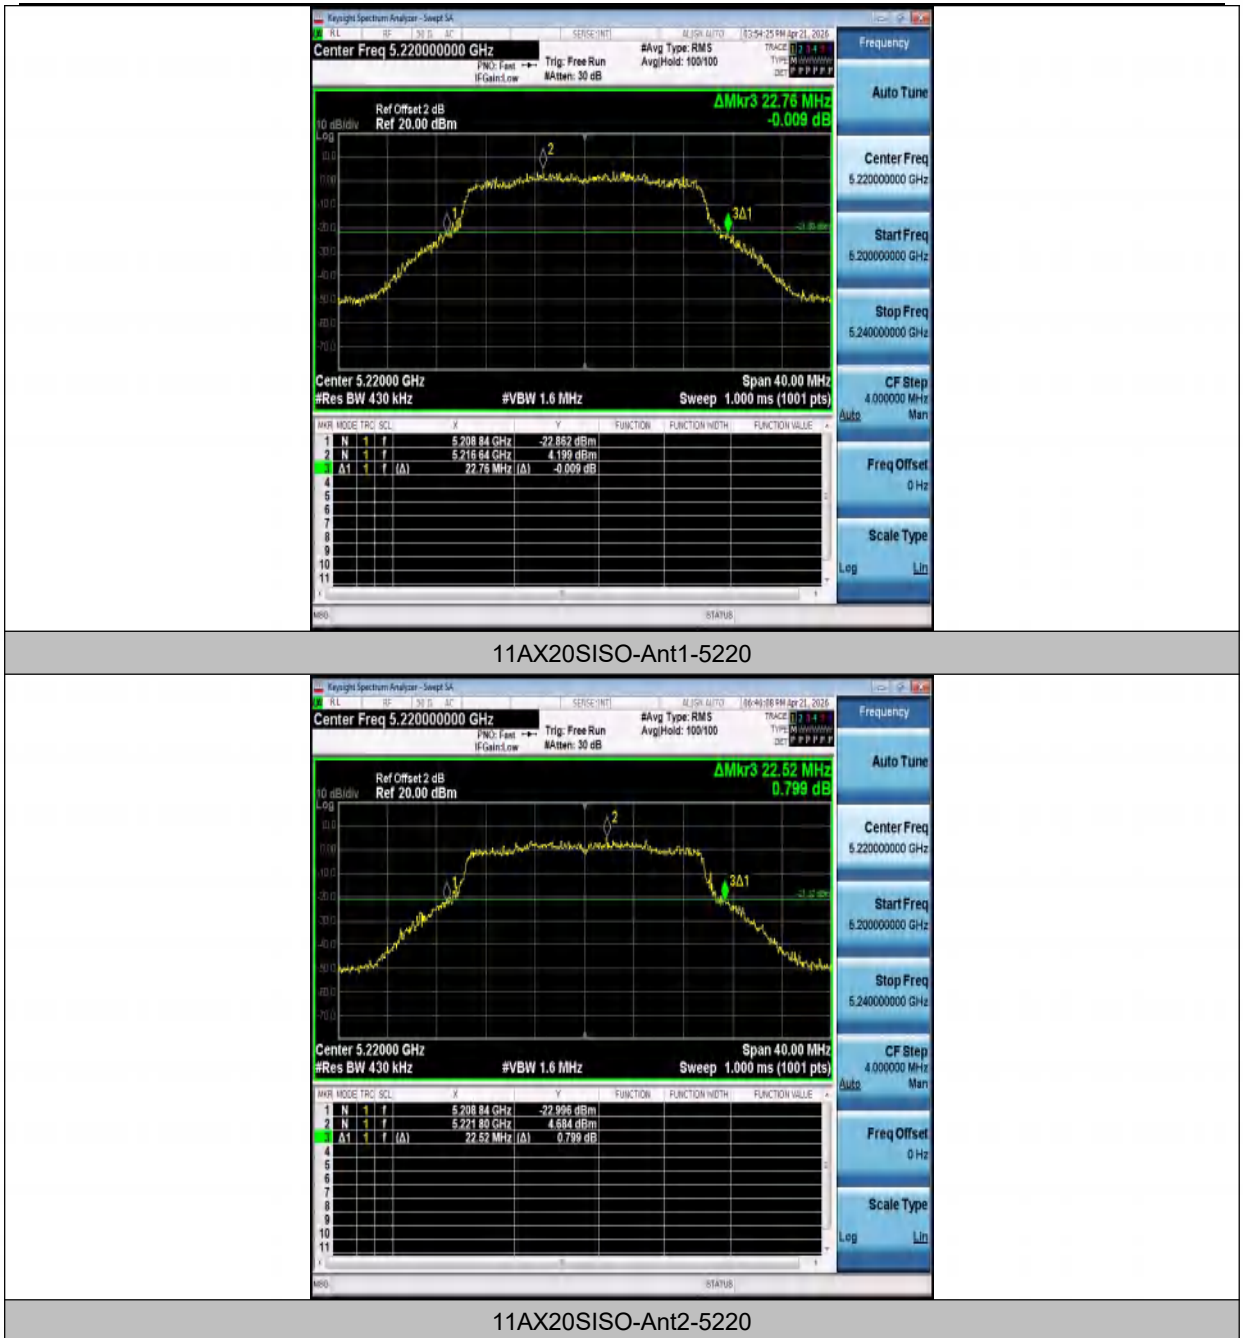


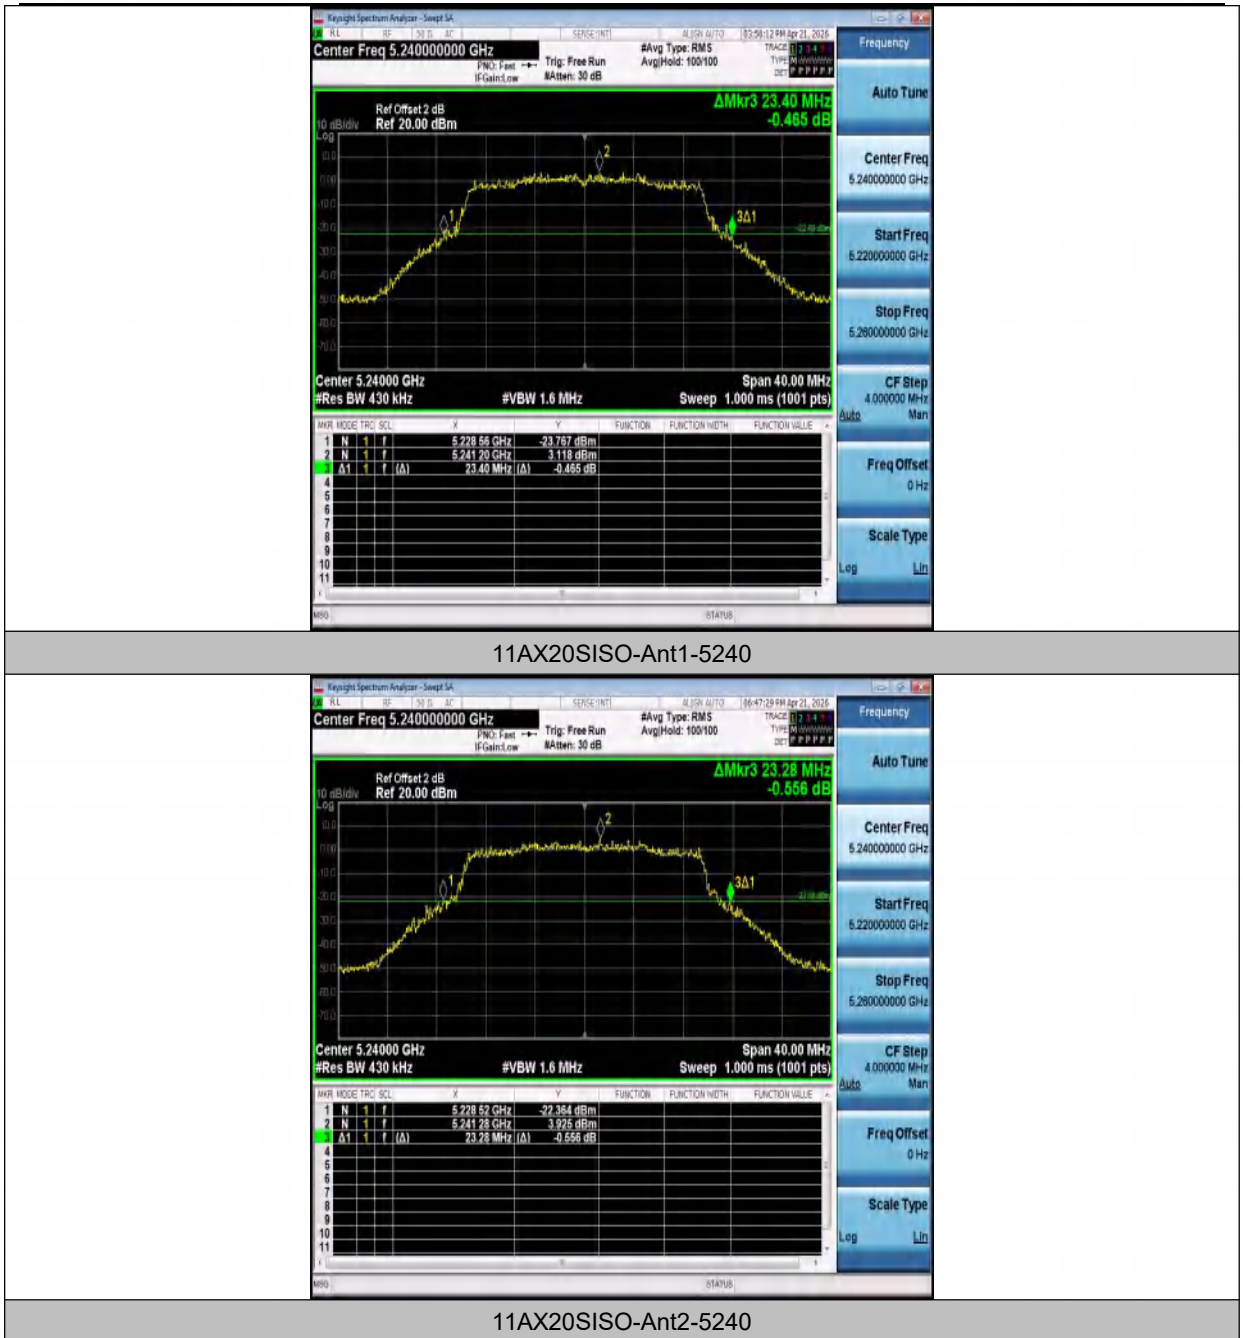


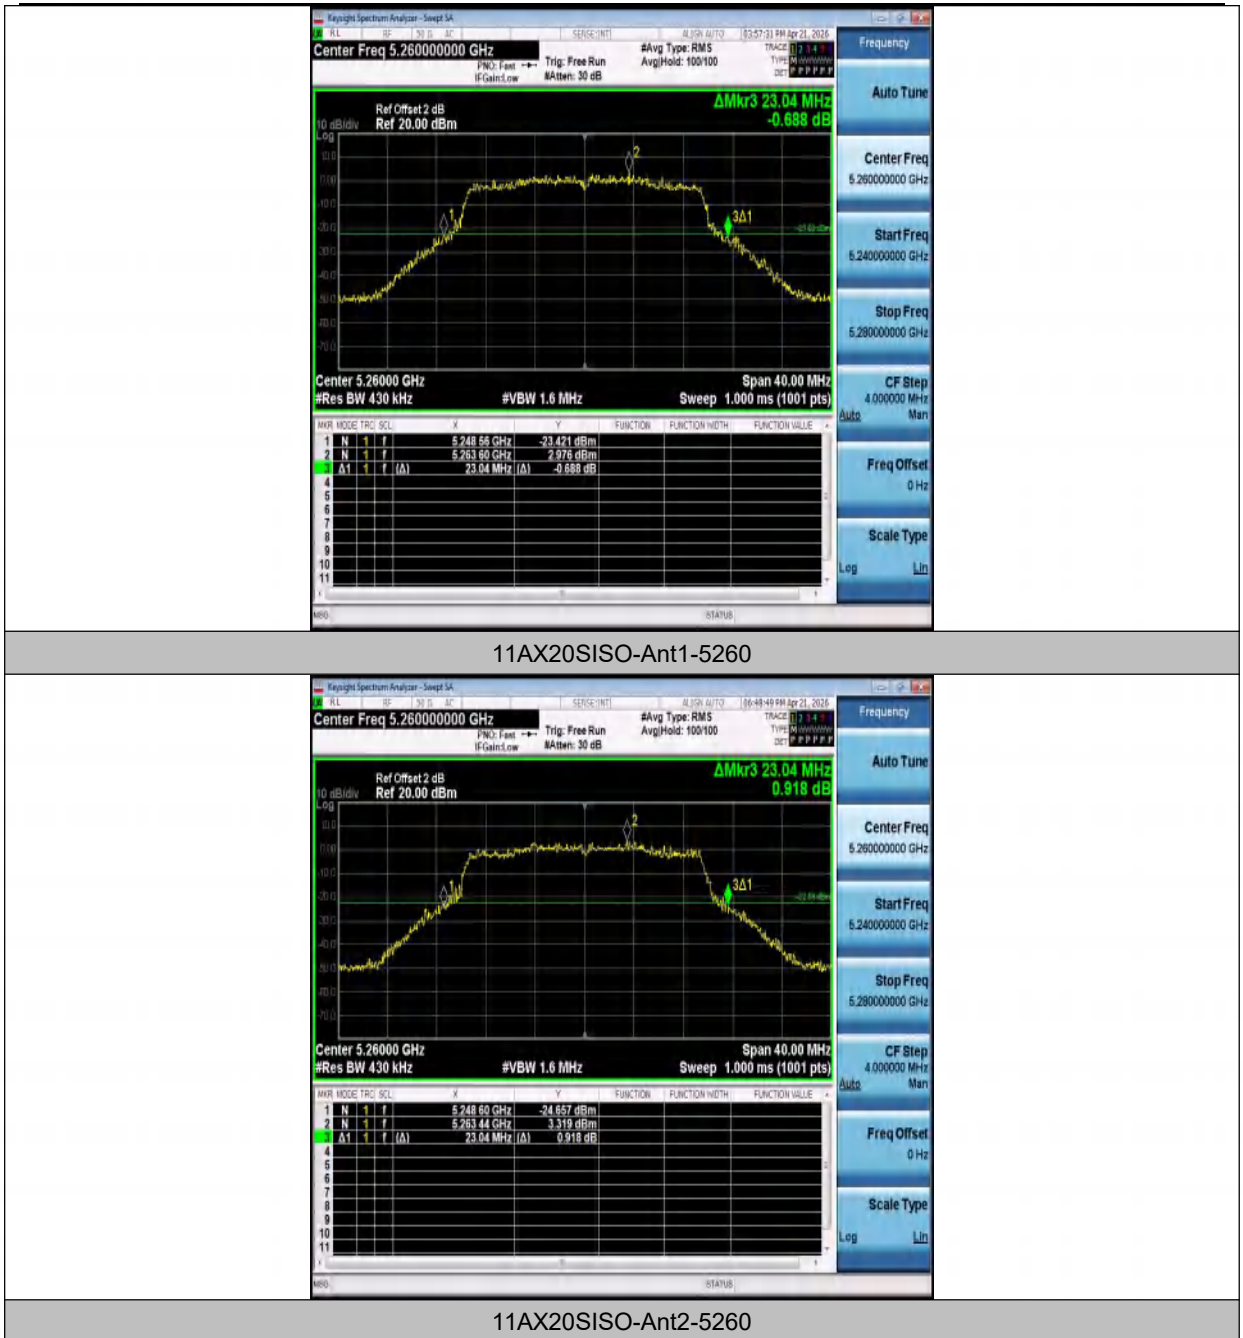


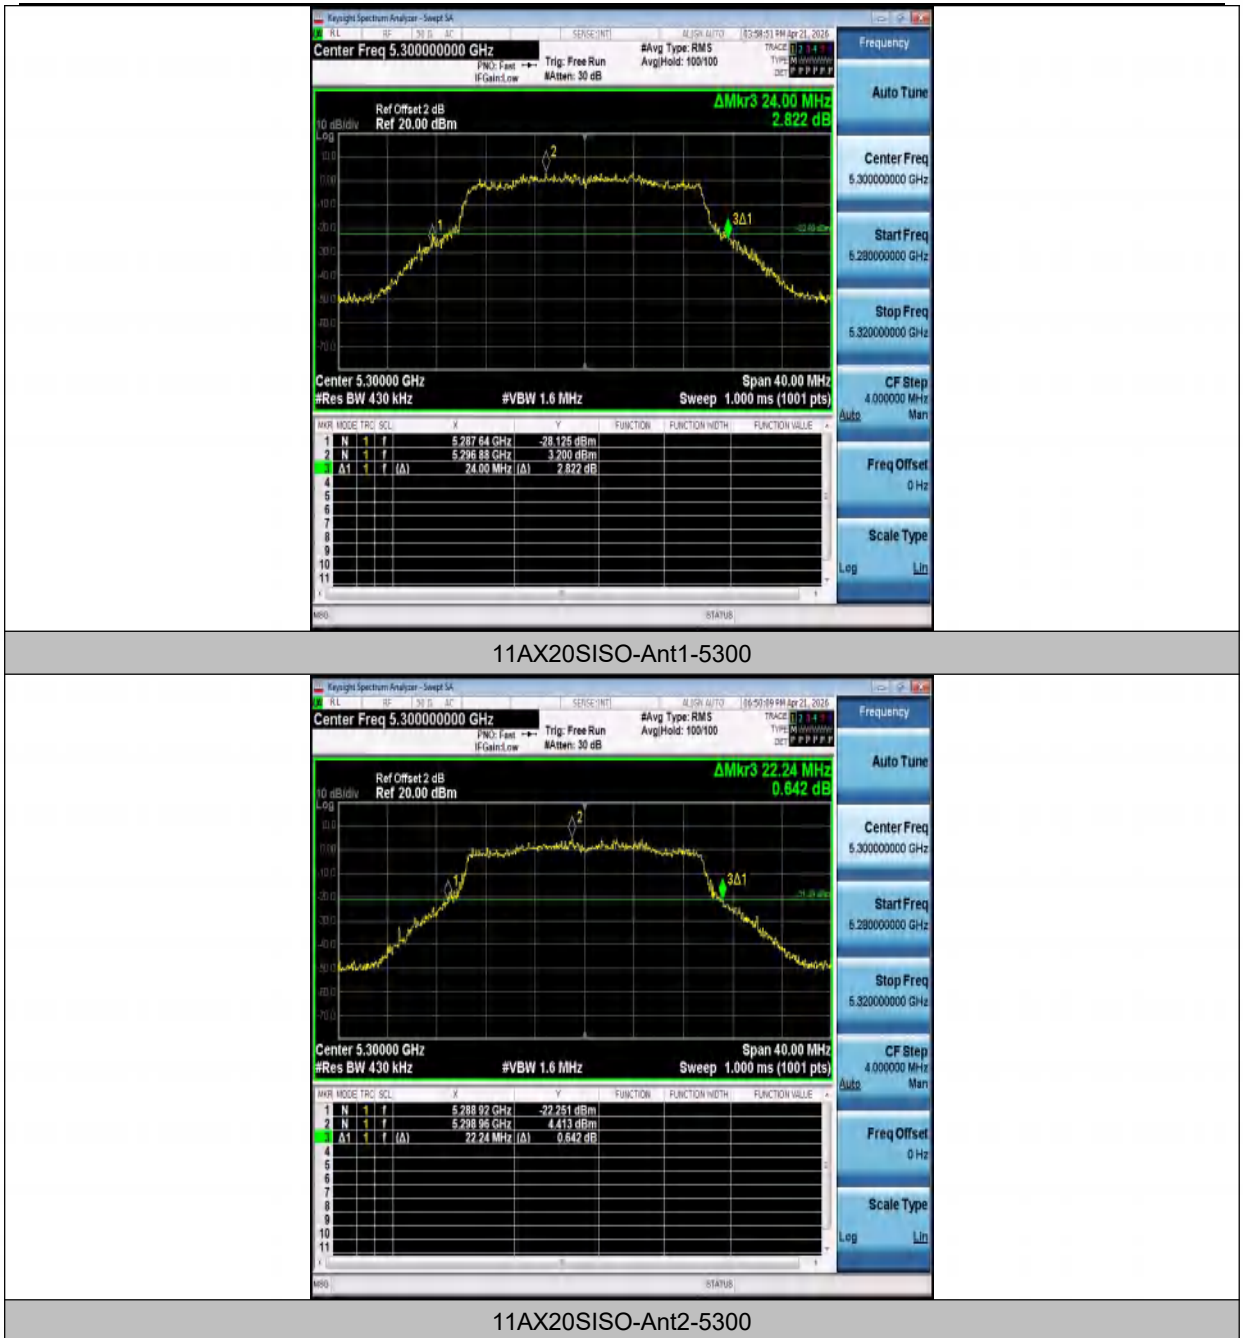





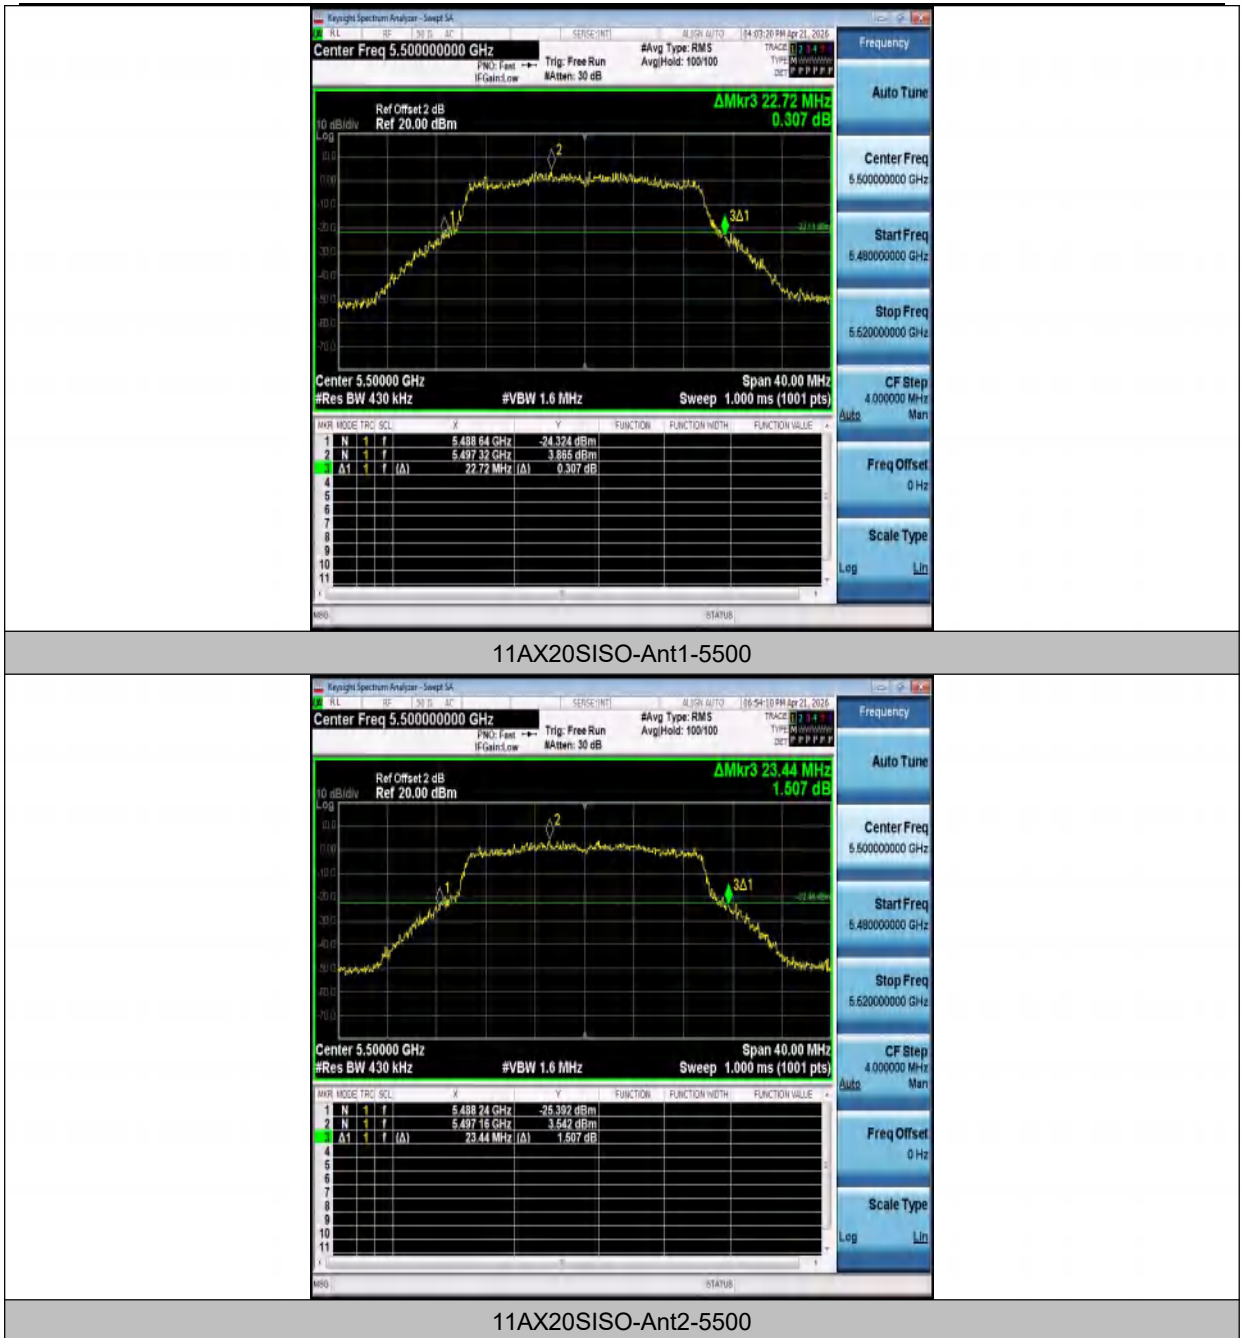


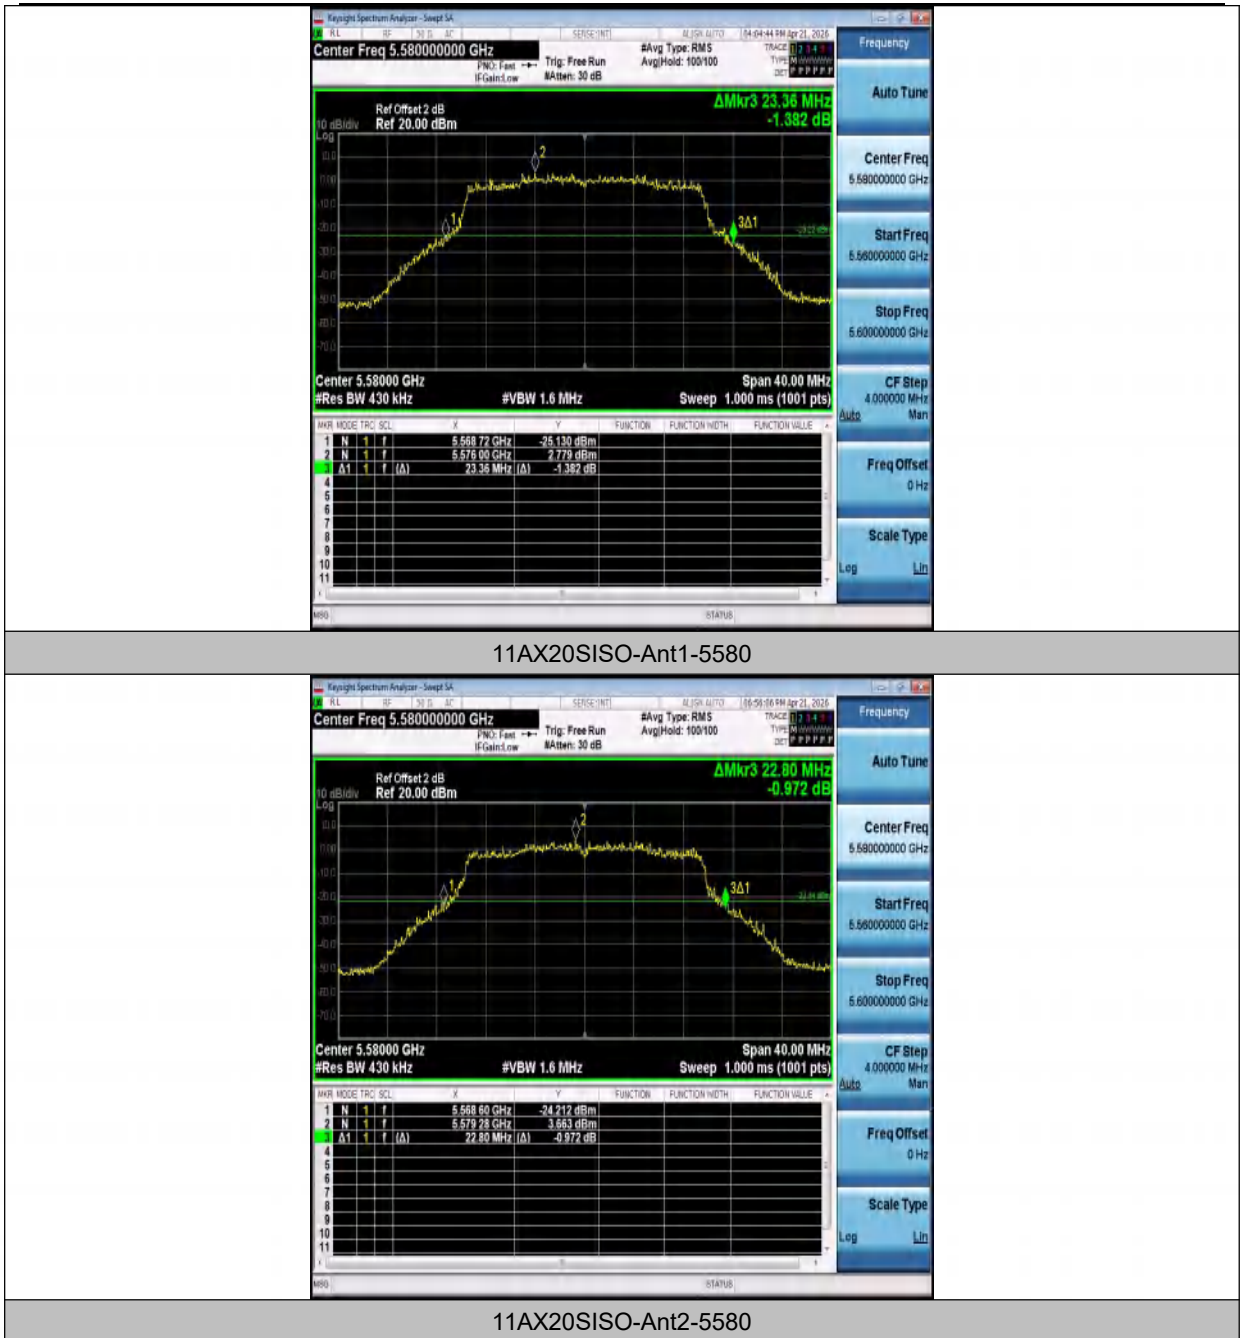


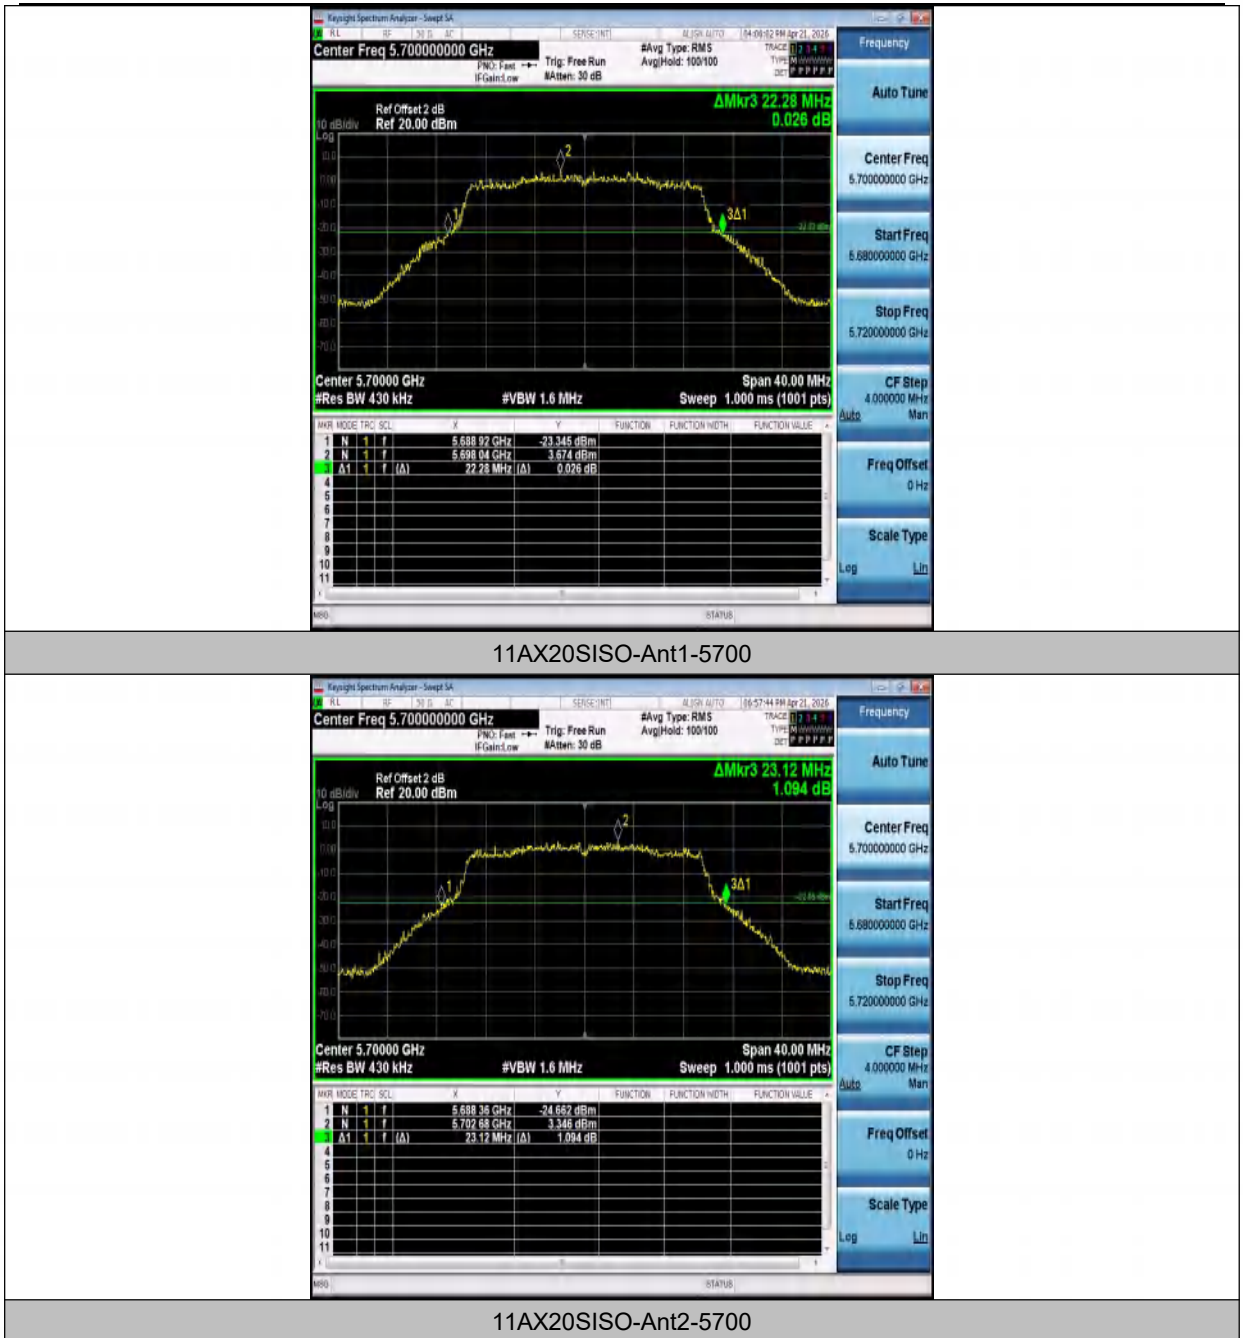


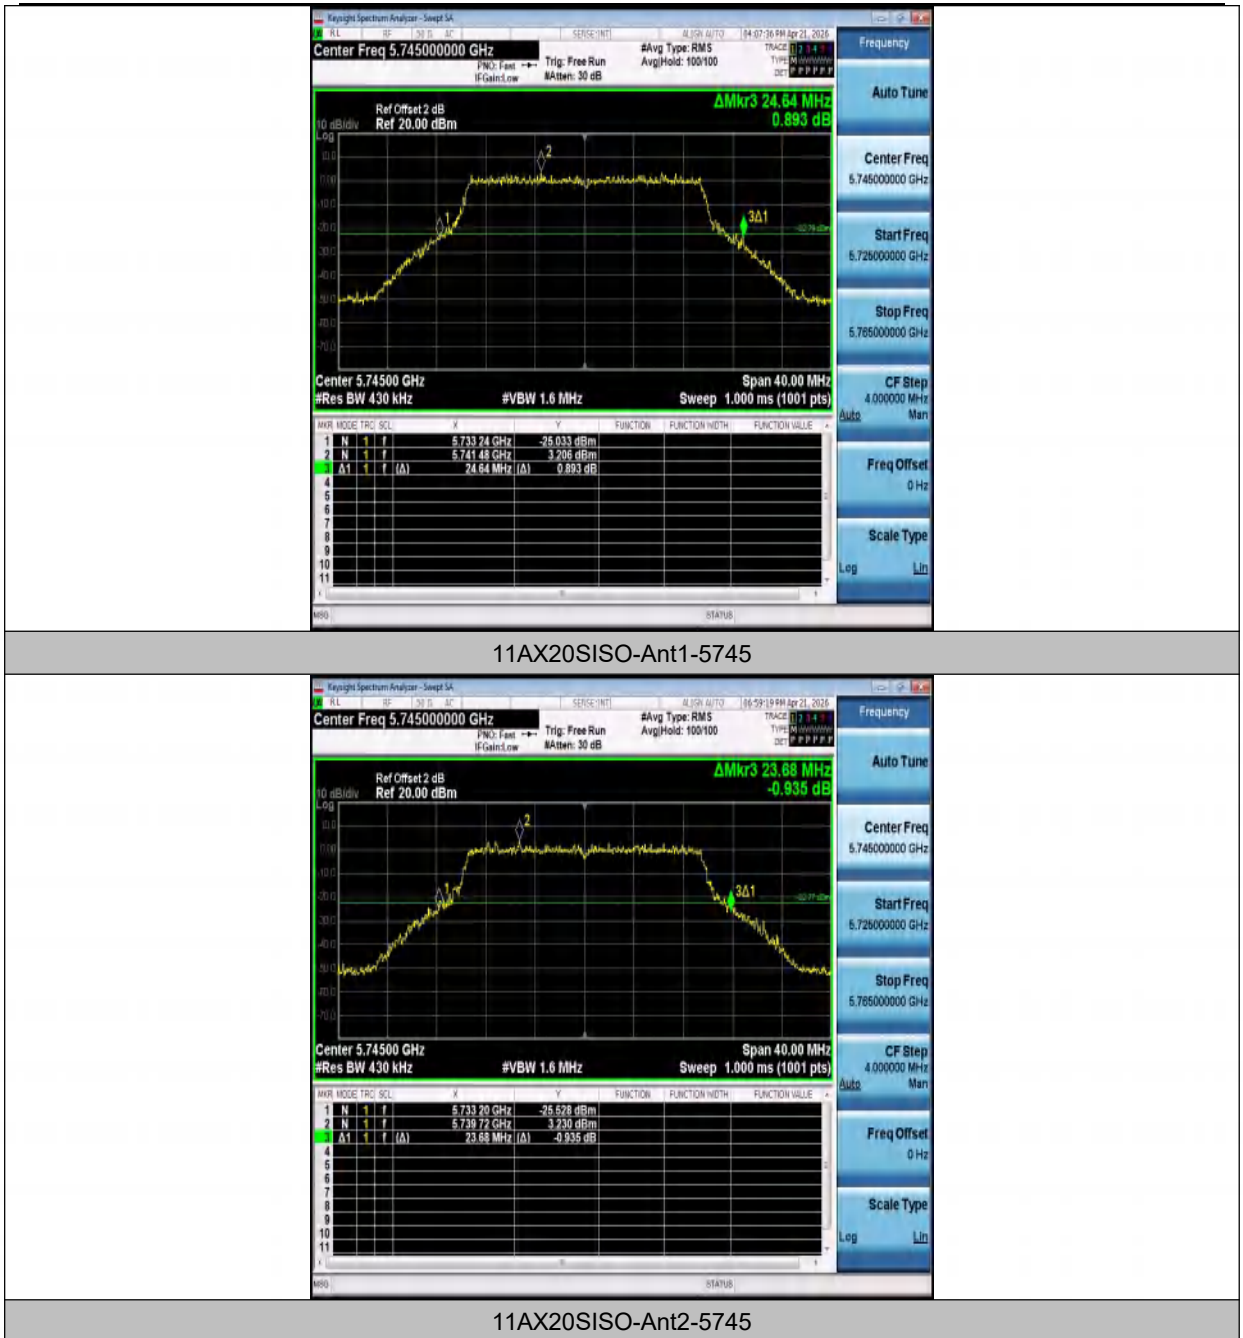

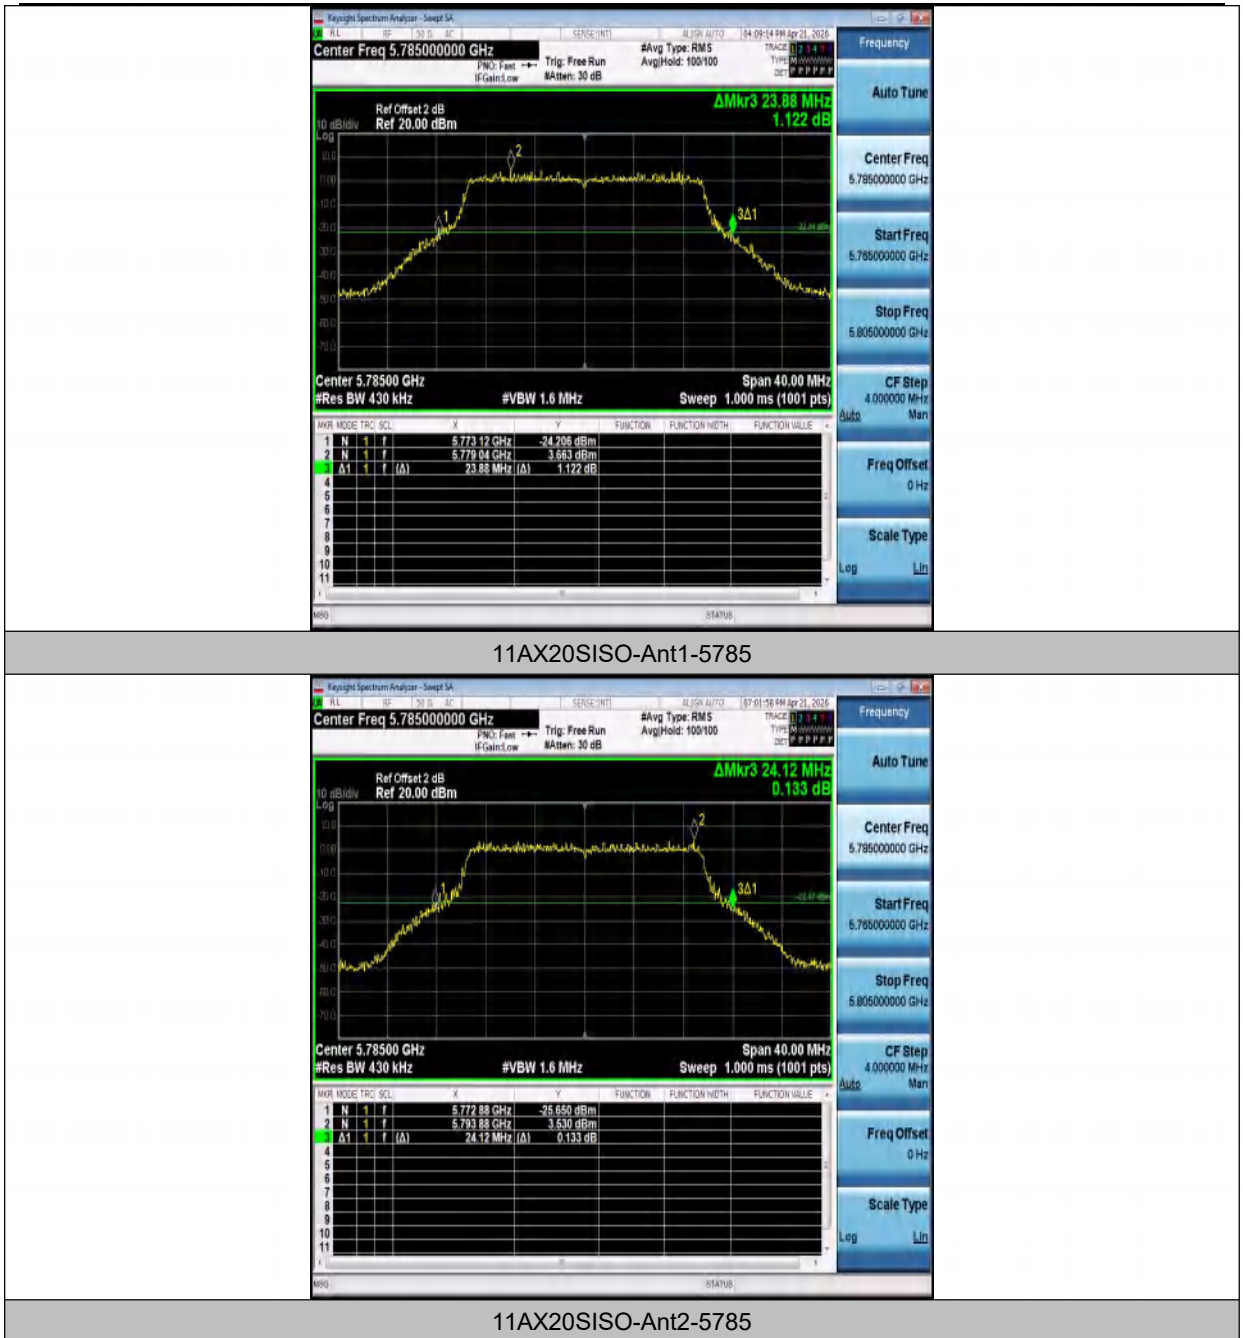

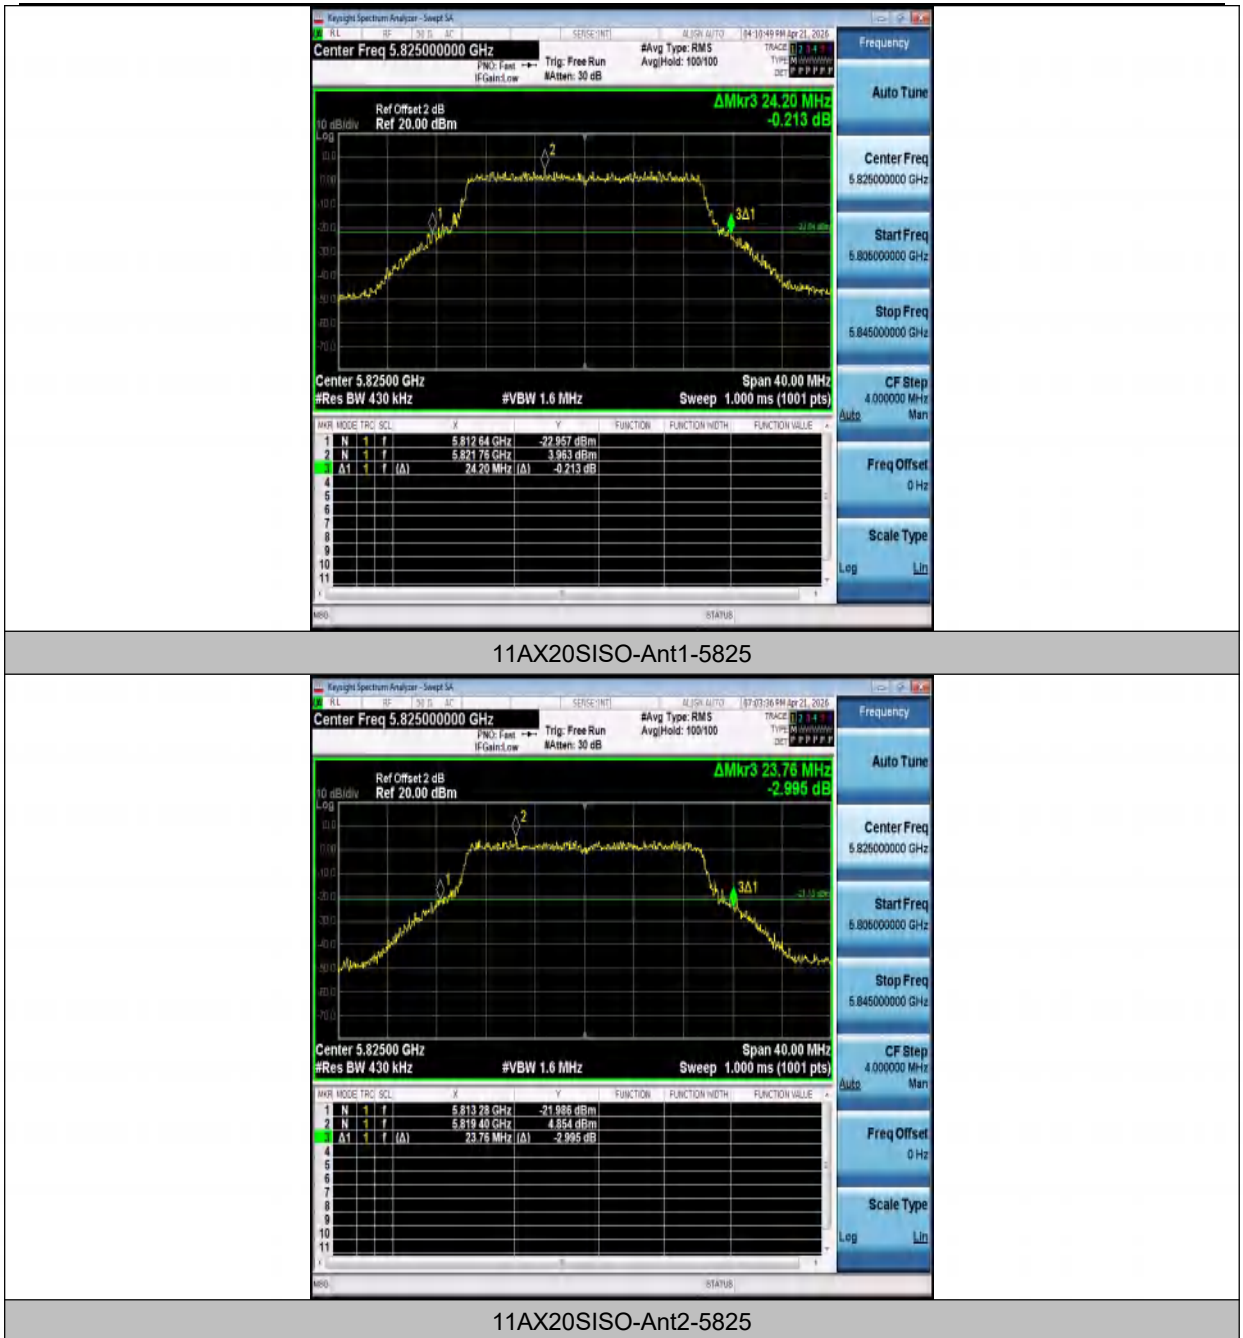

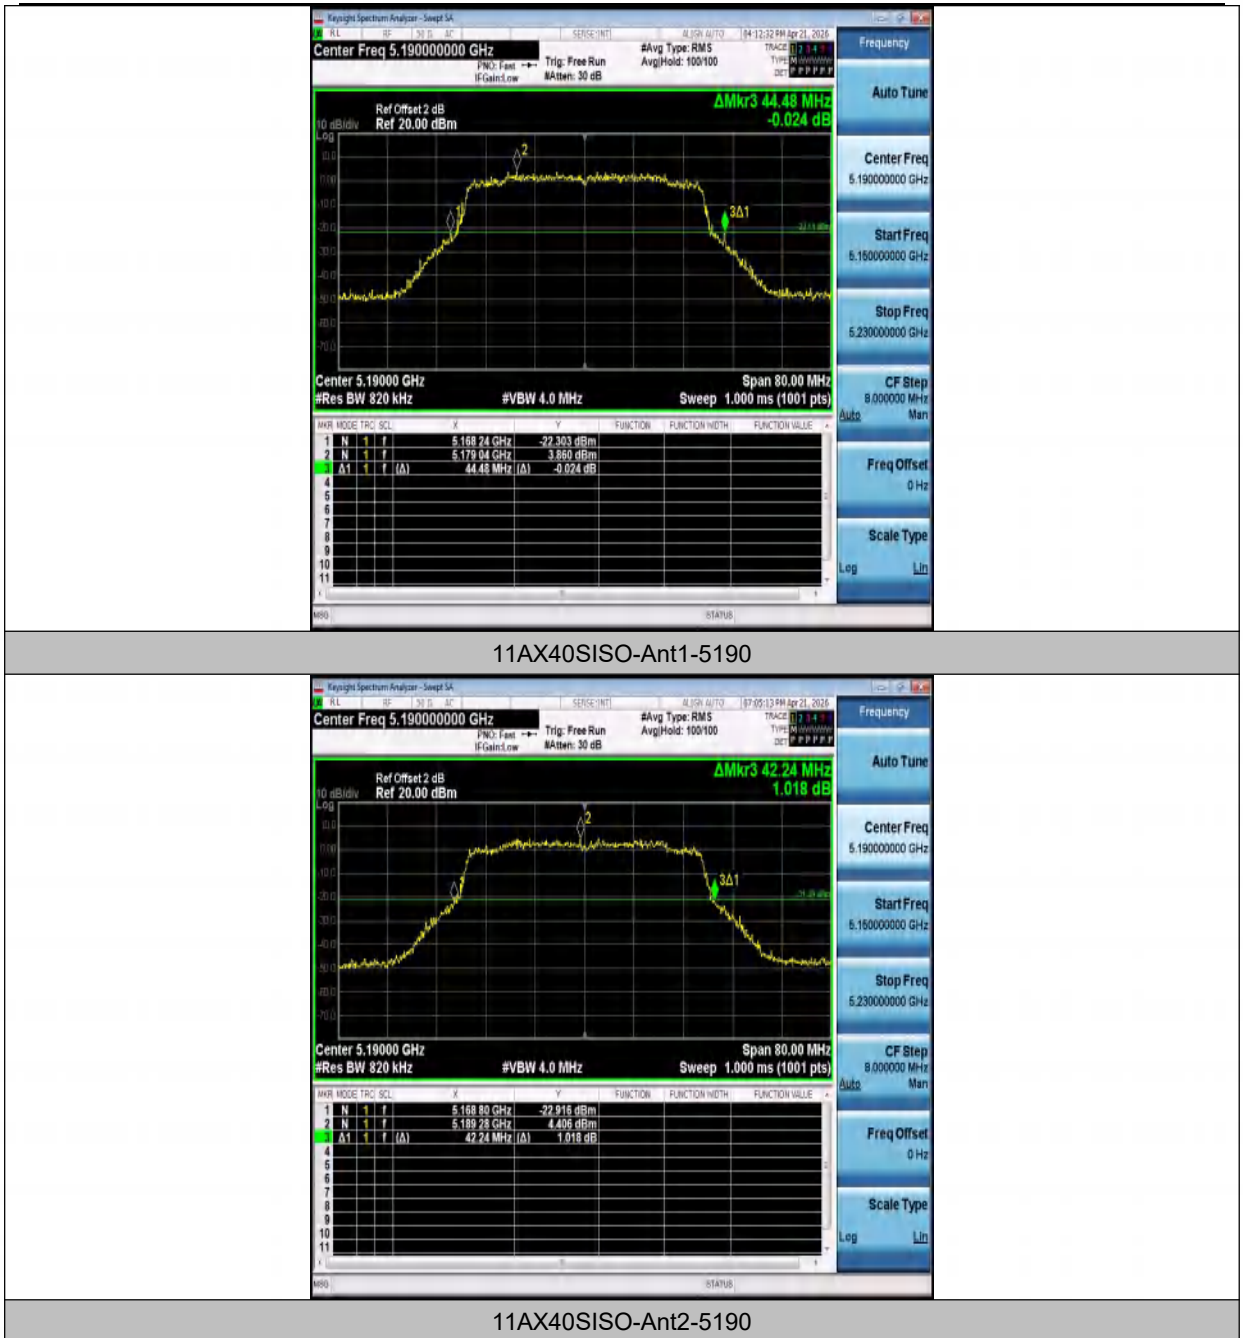


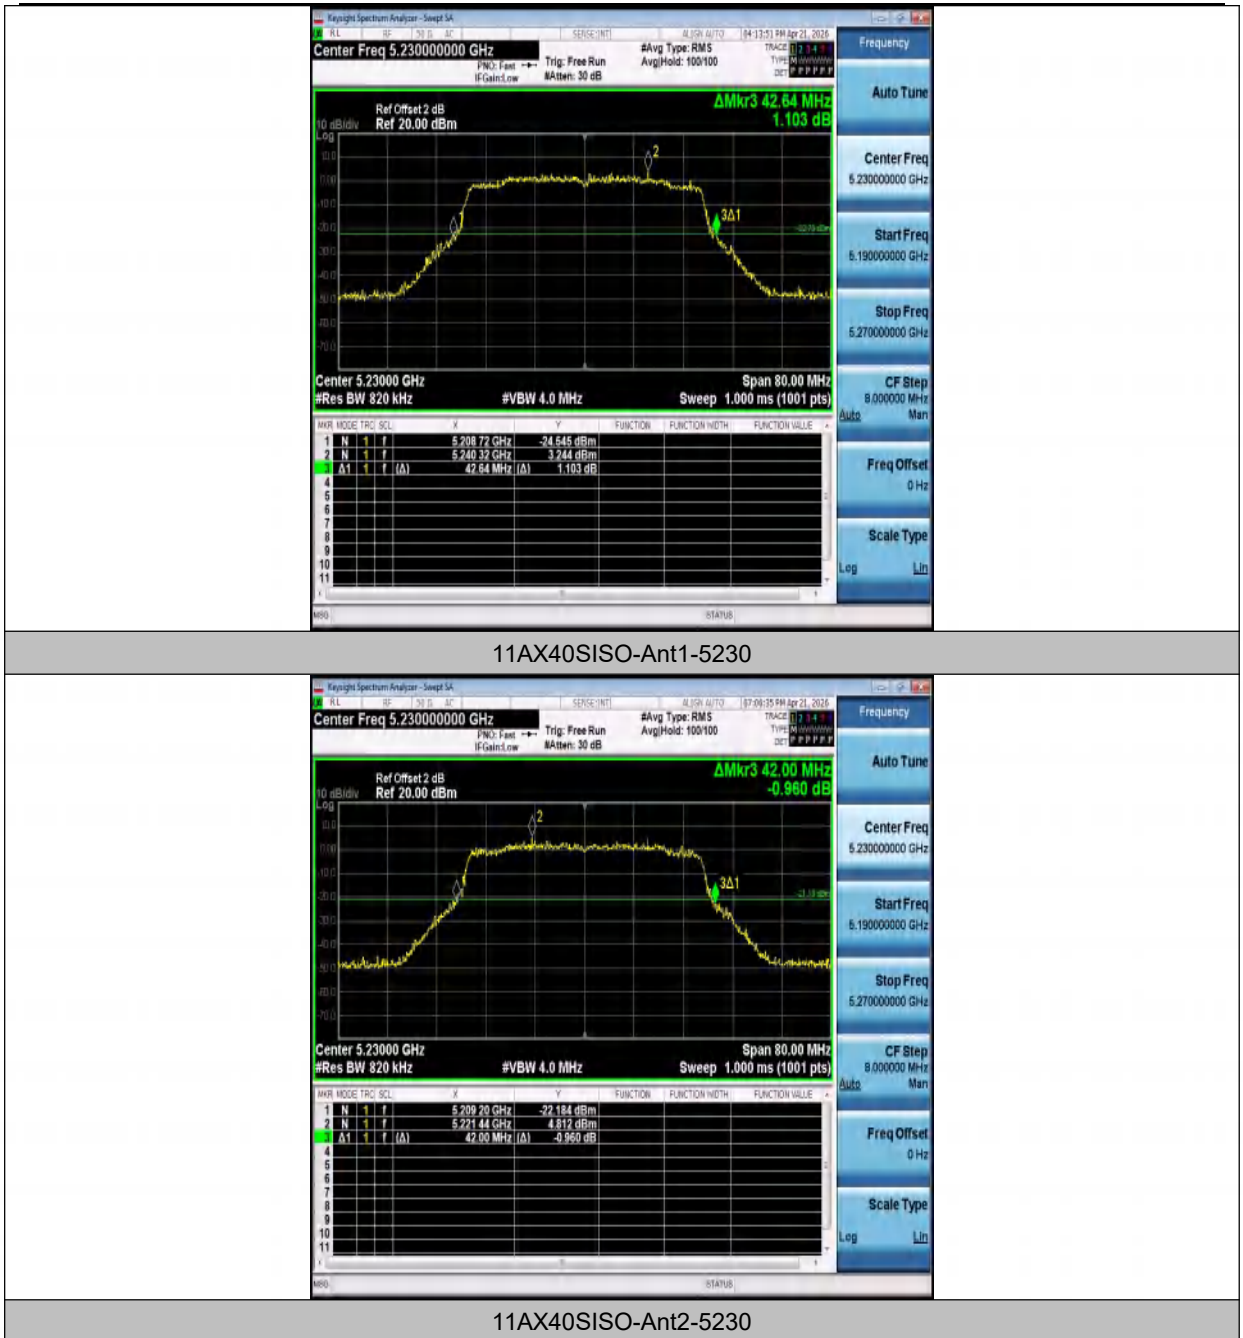

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

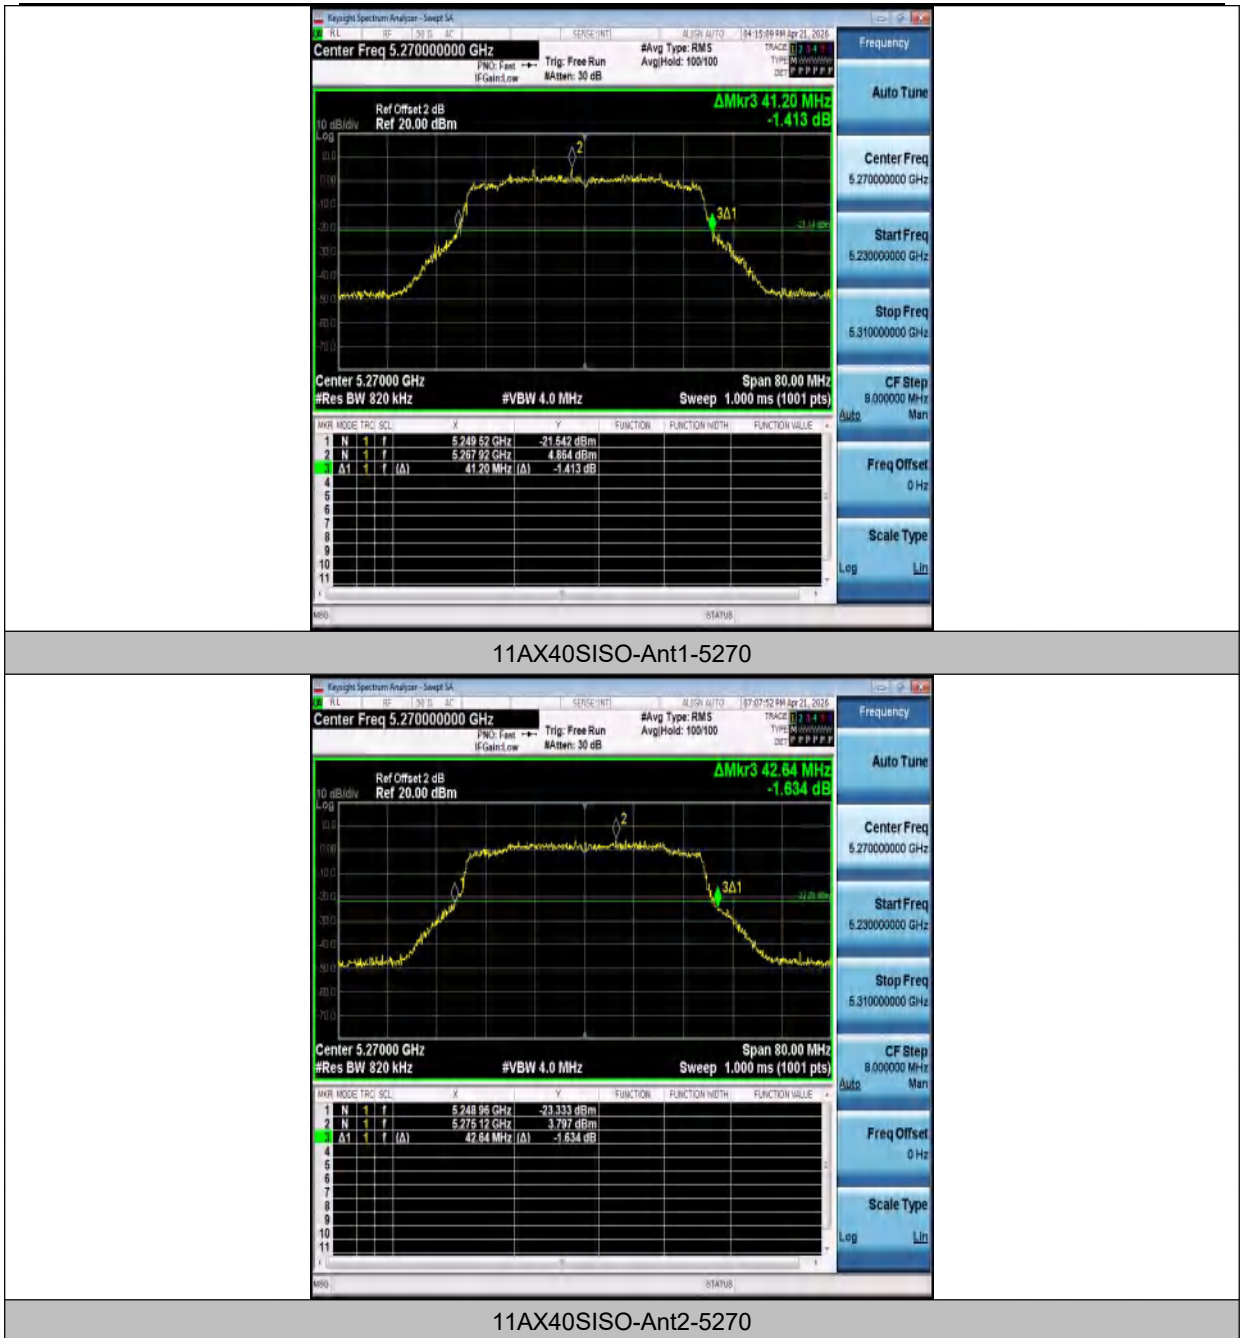

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

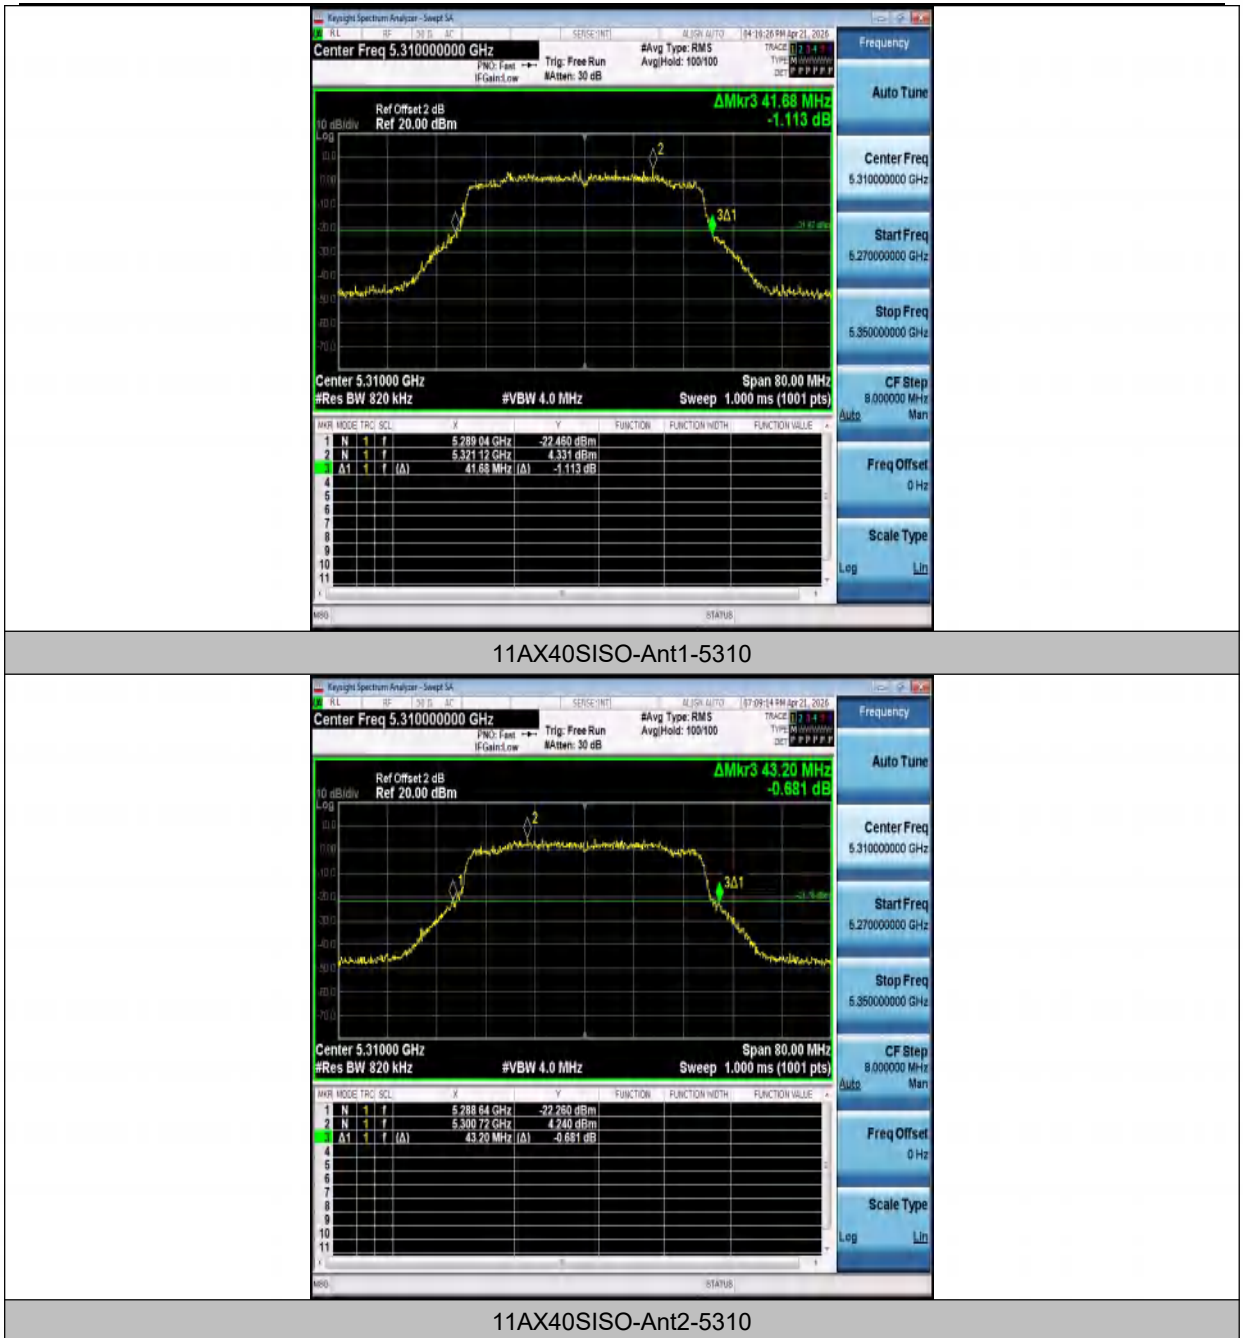



Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



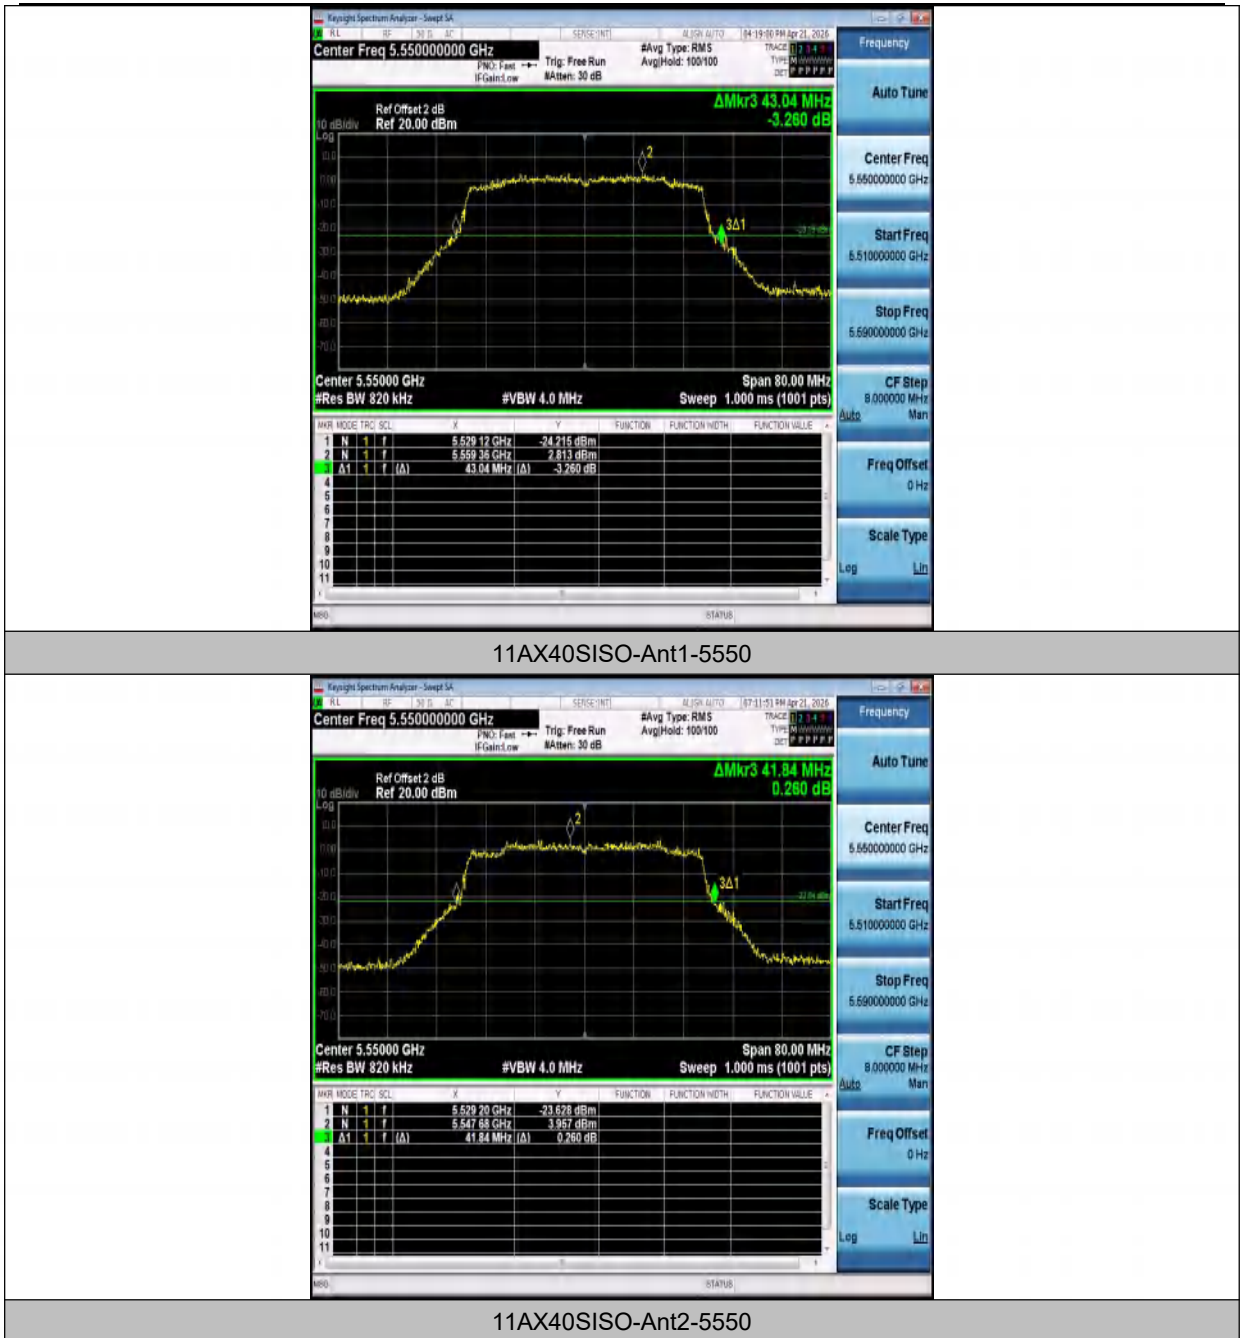


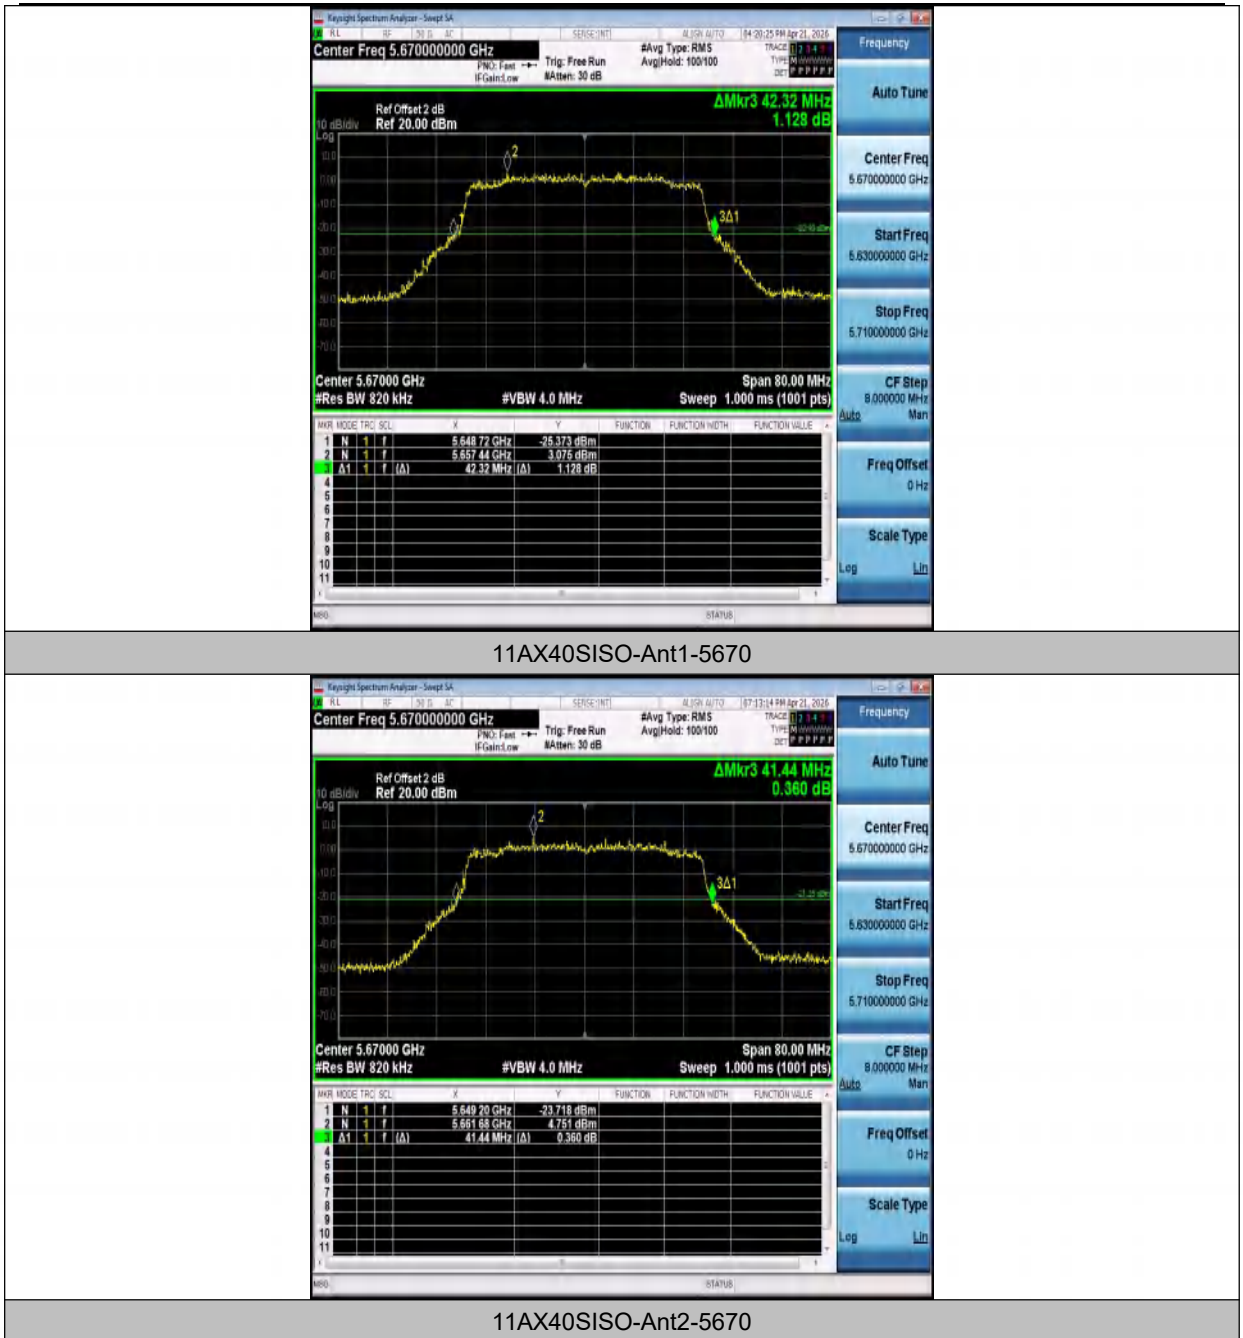

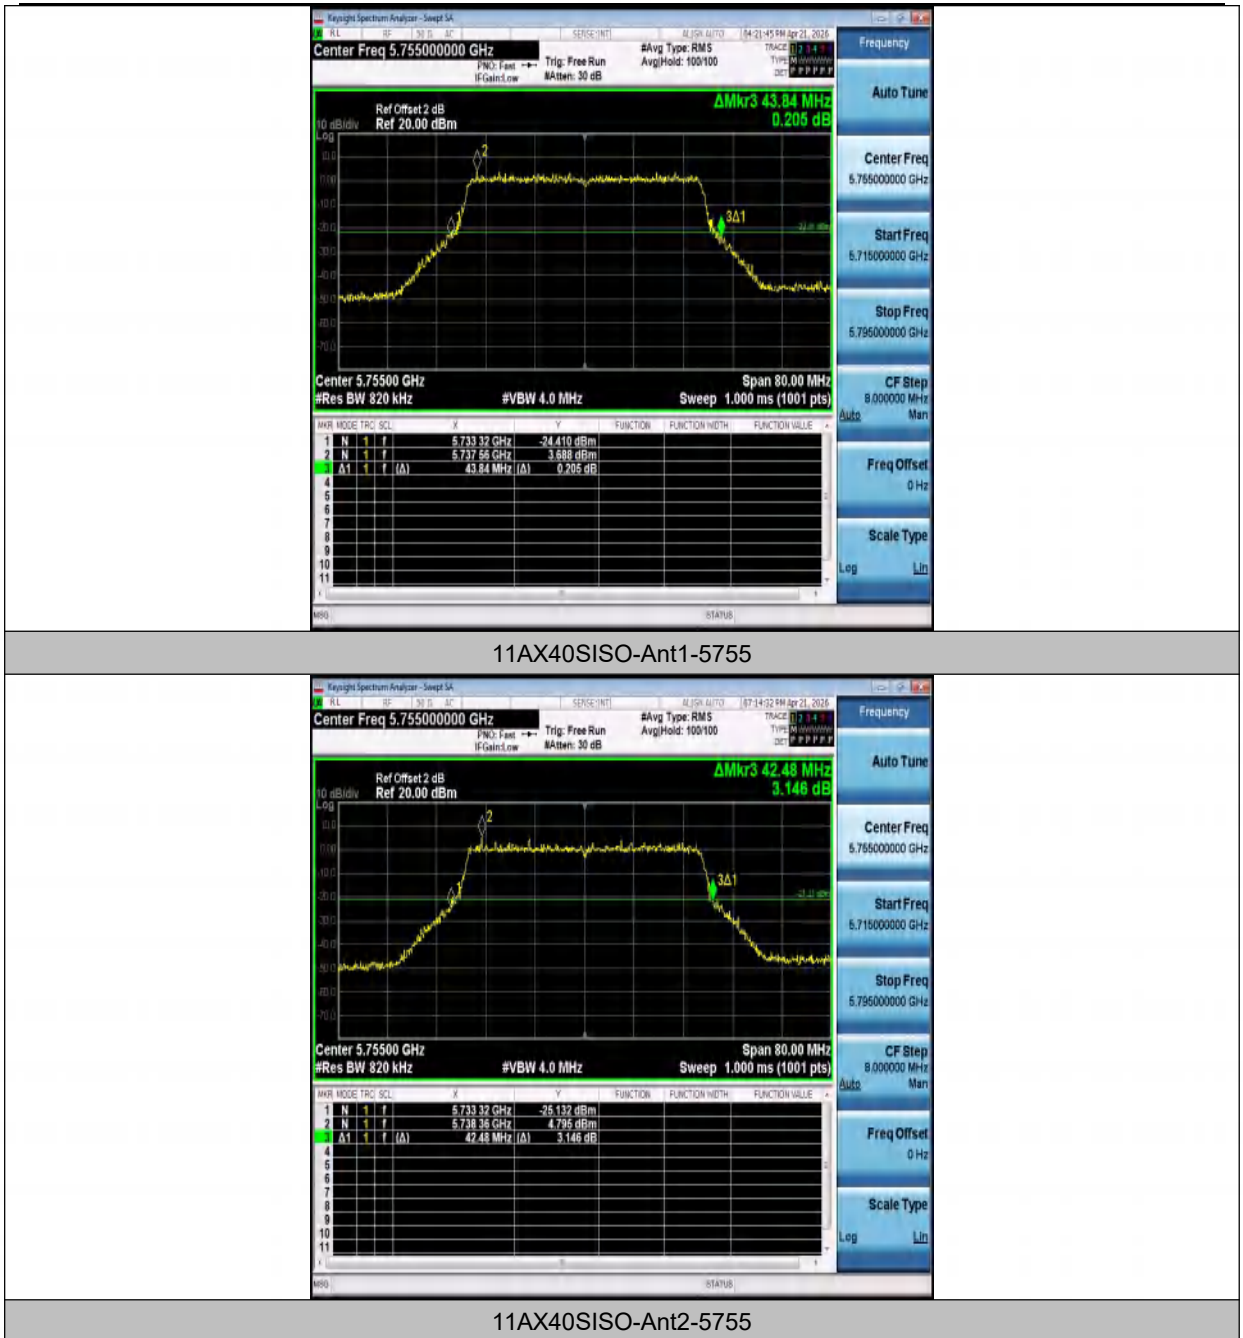





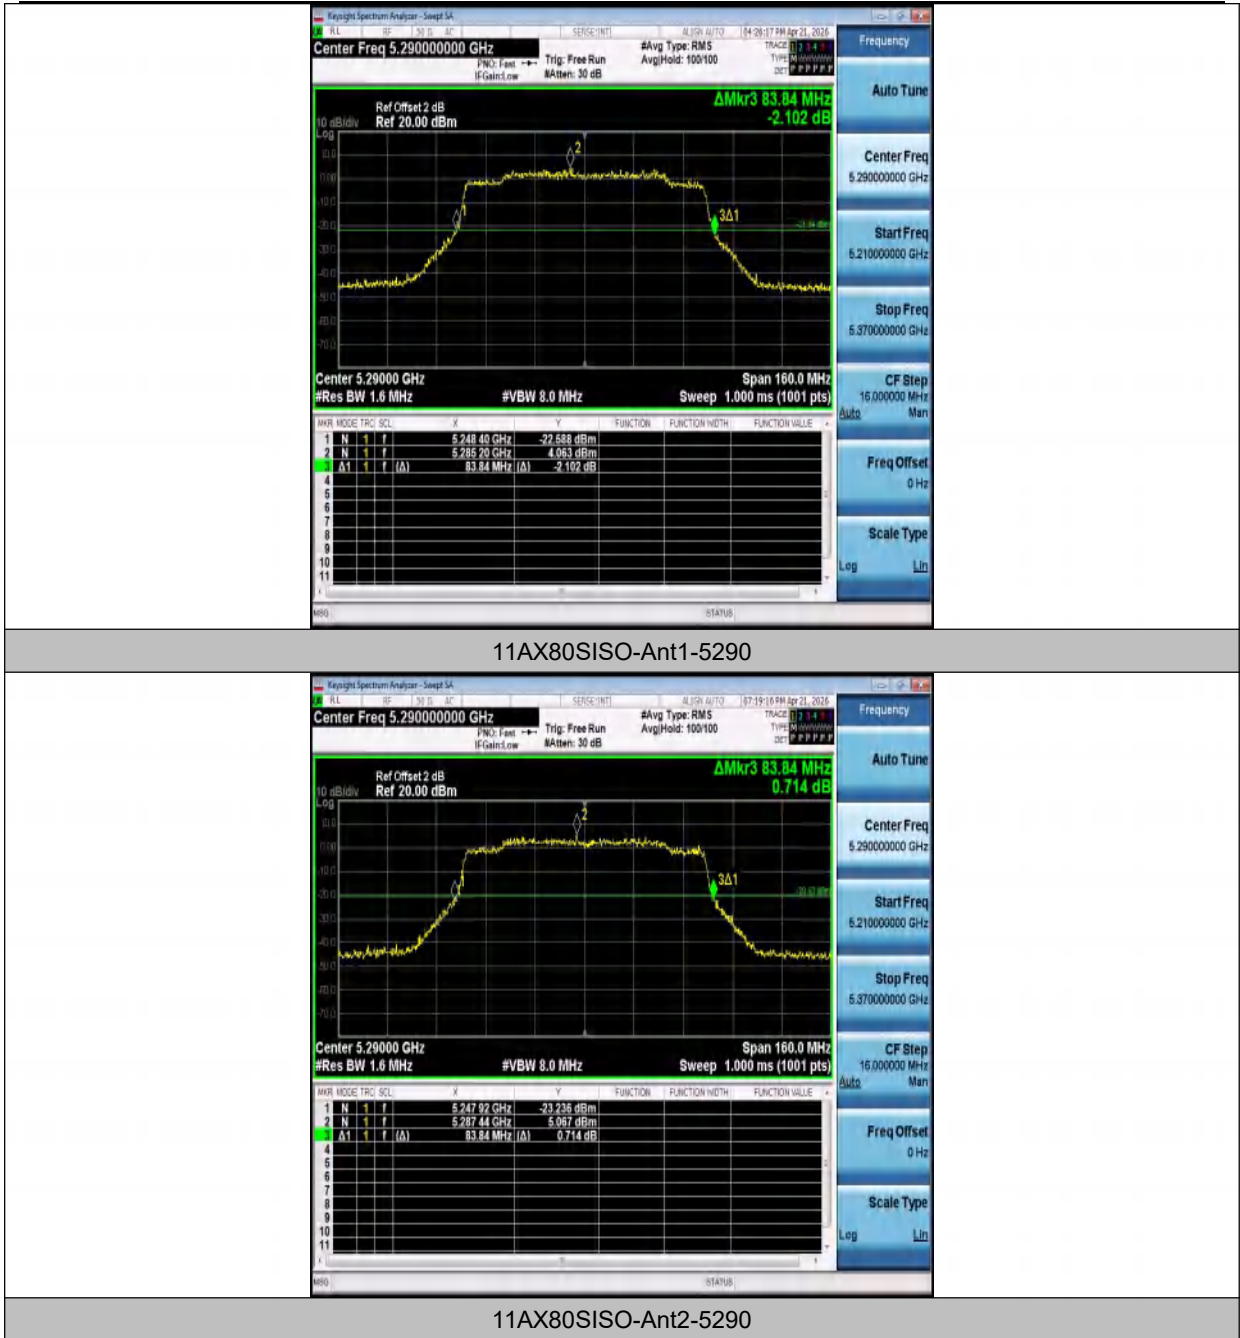





Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

