



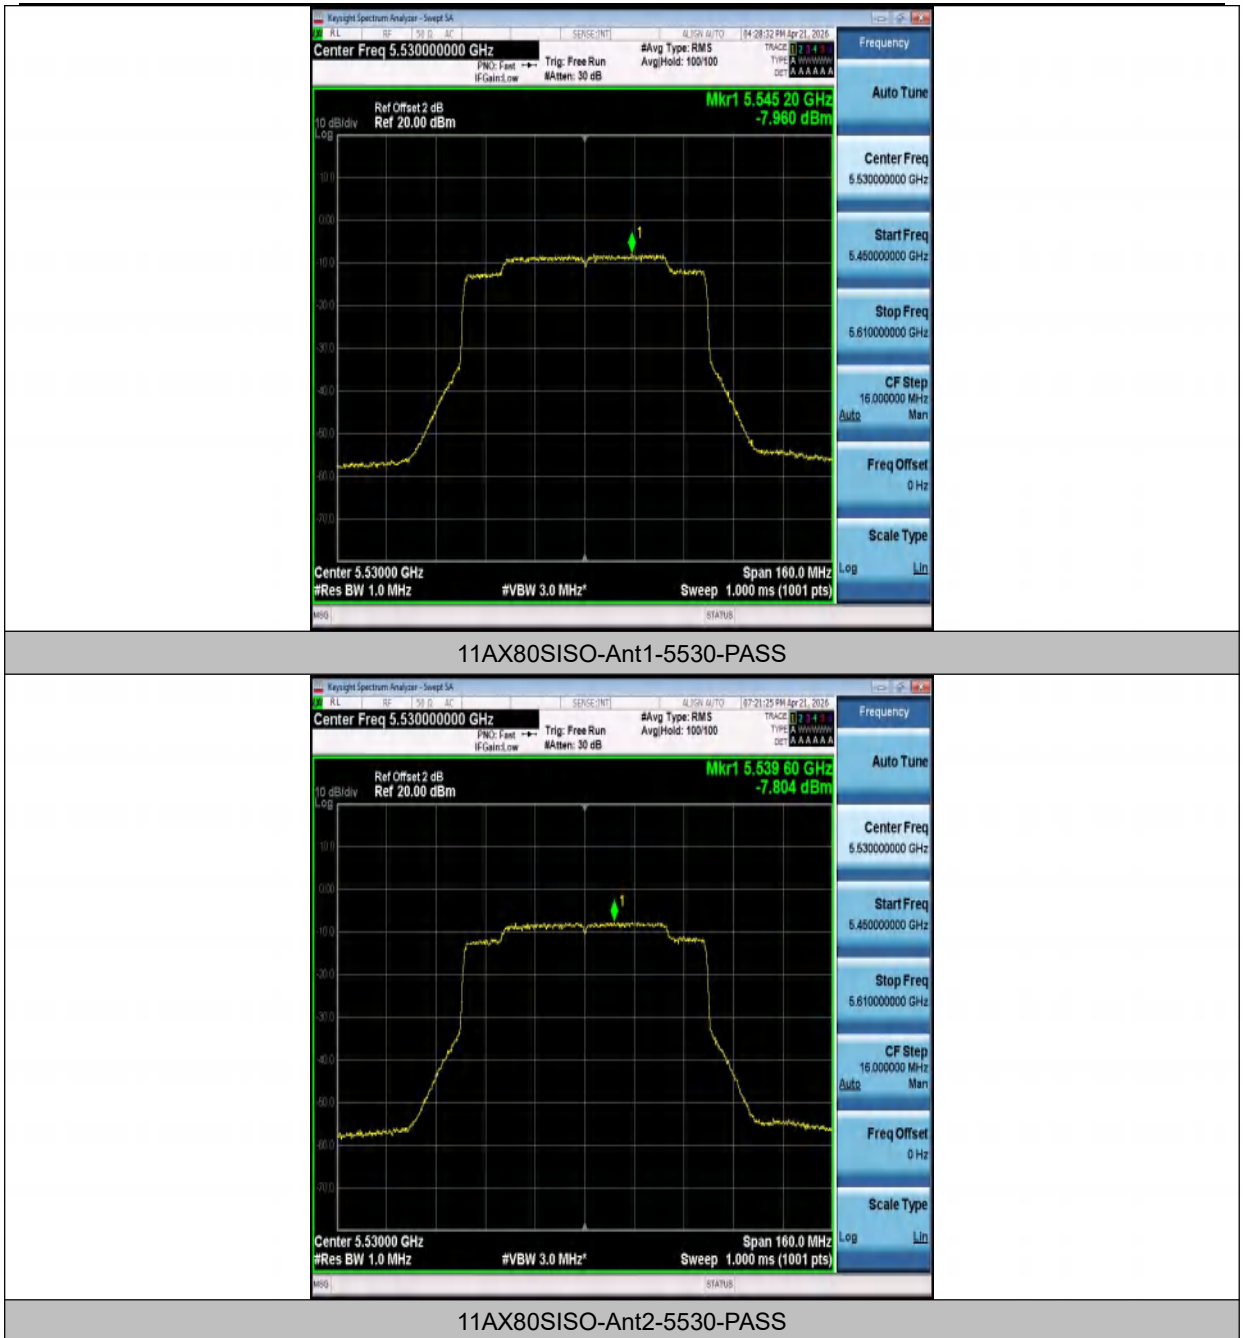

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

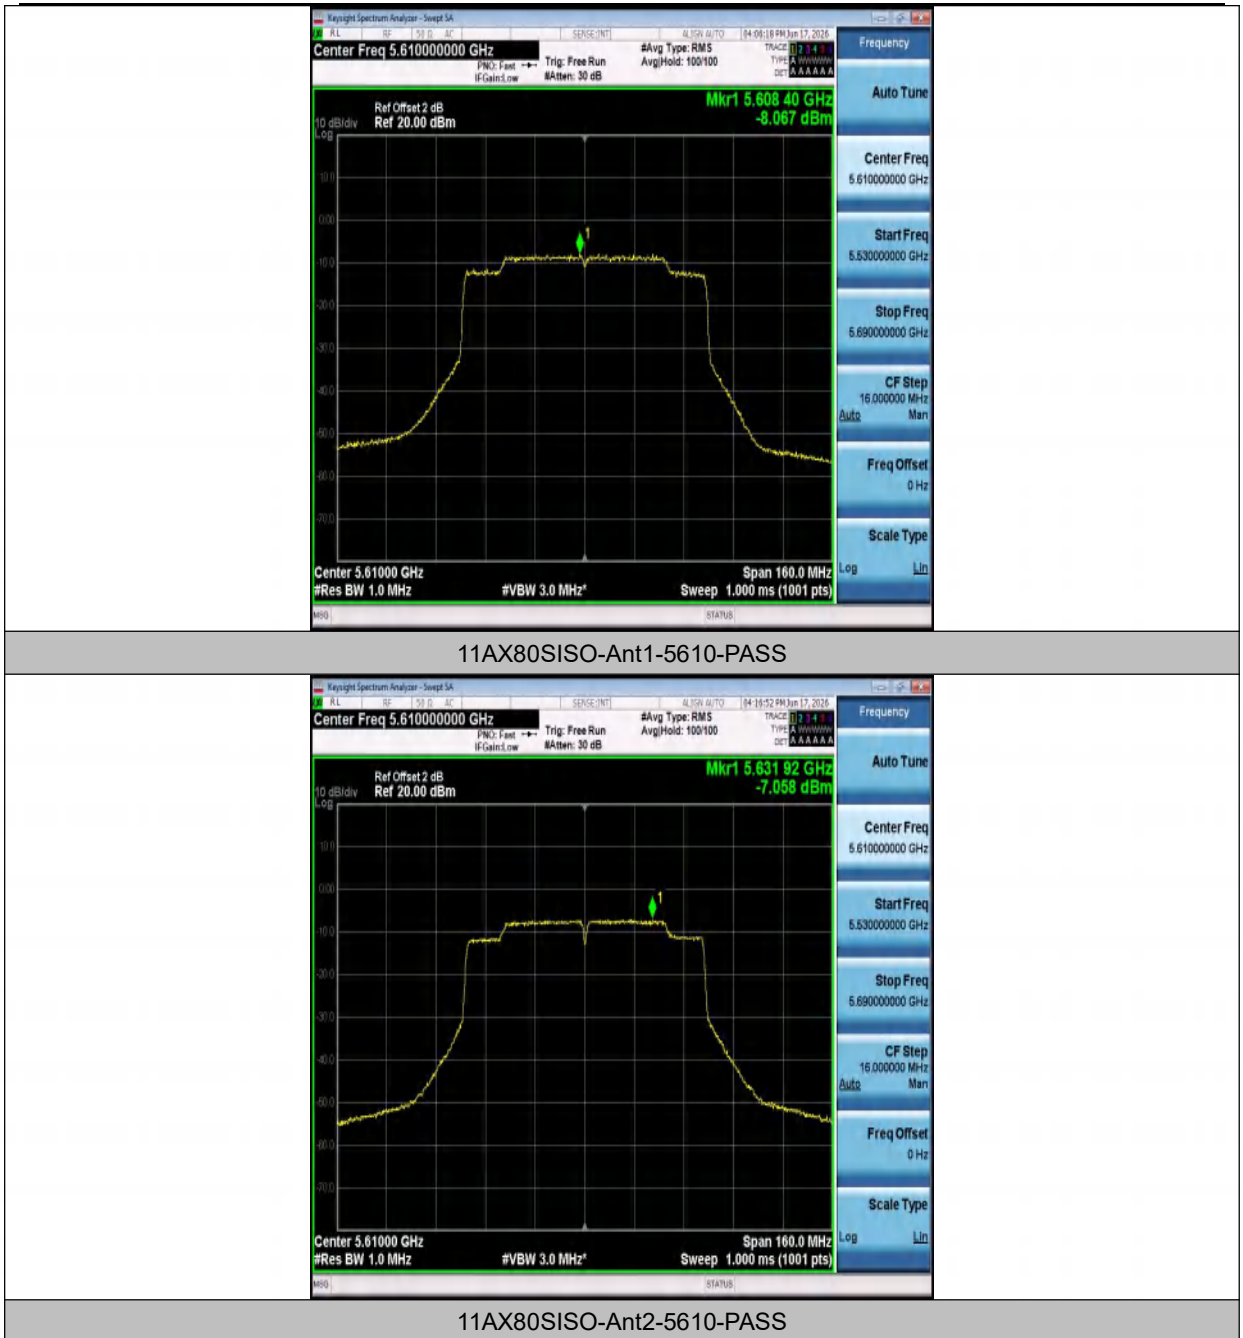


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Test GraphsB4

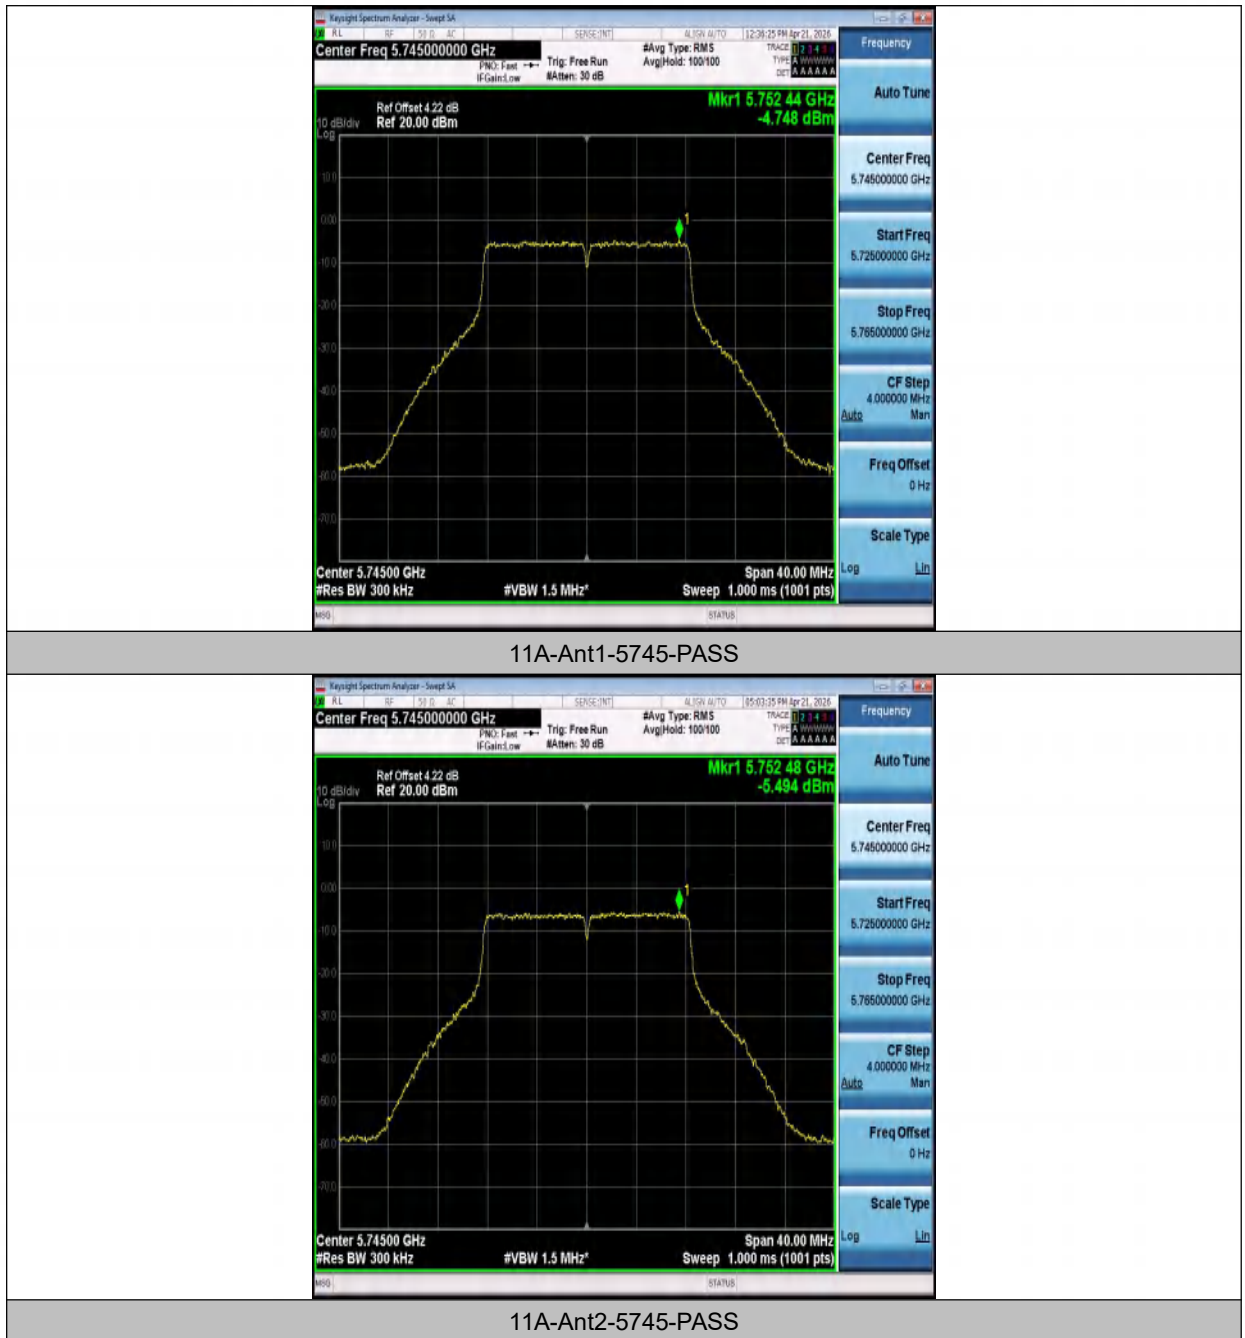

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

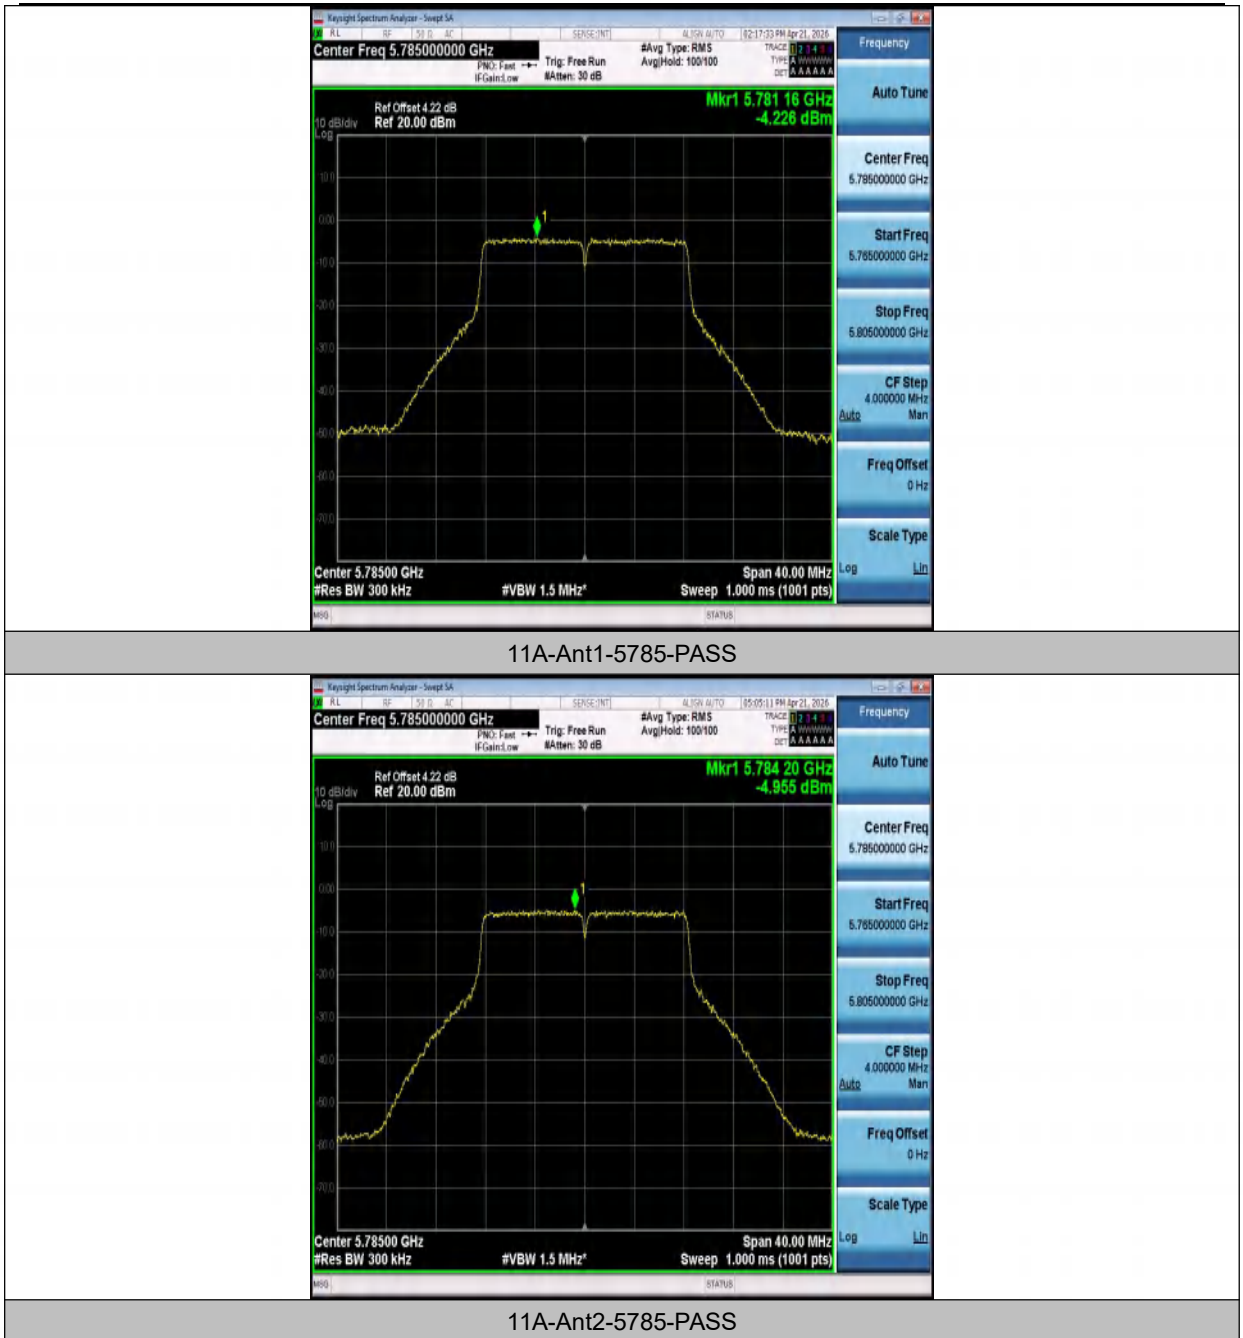

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

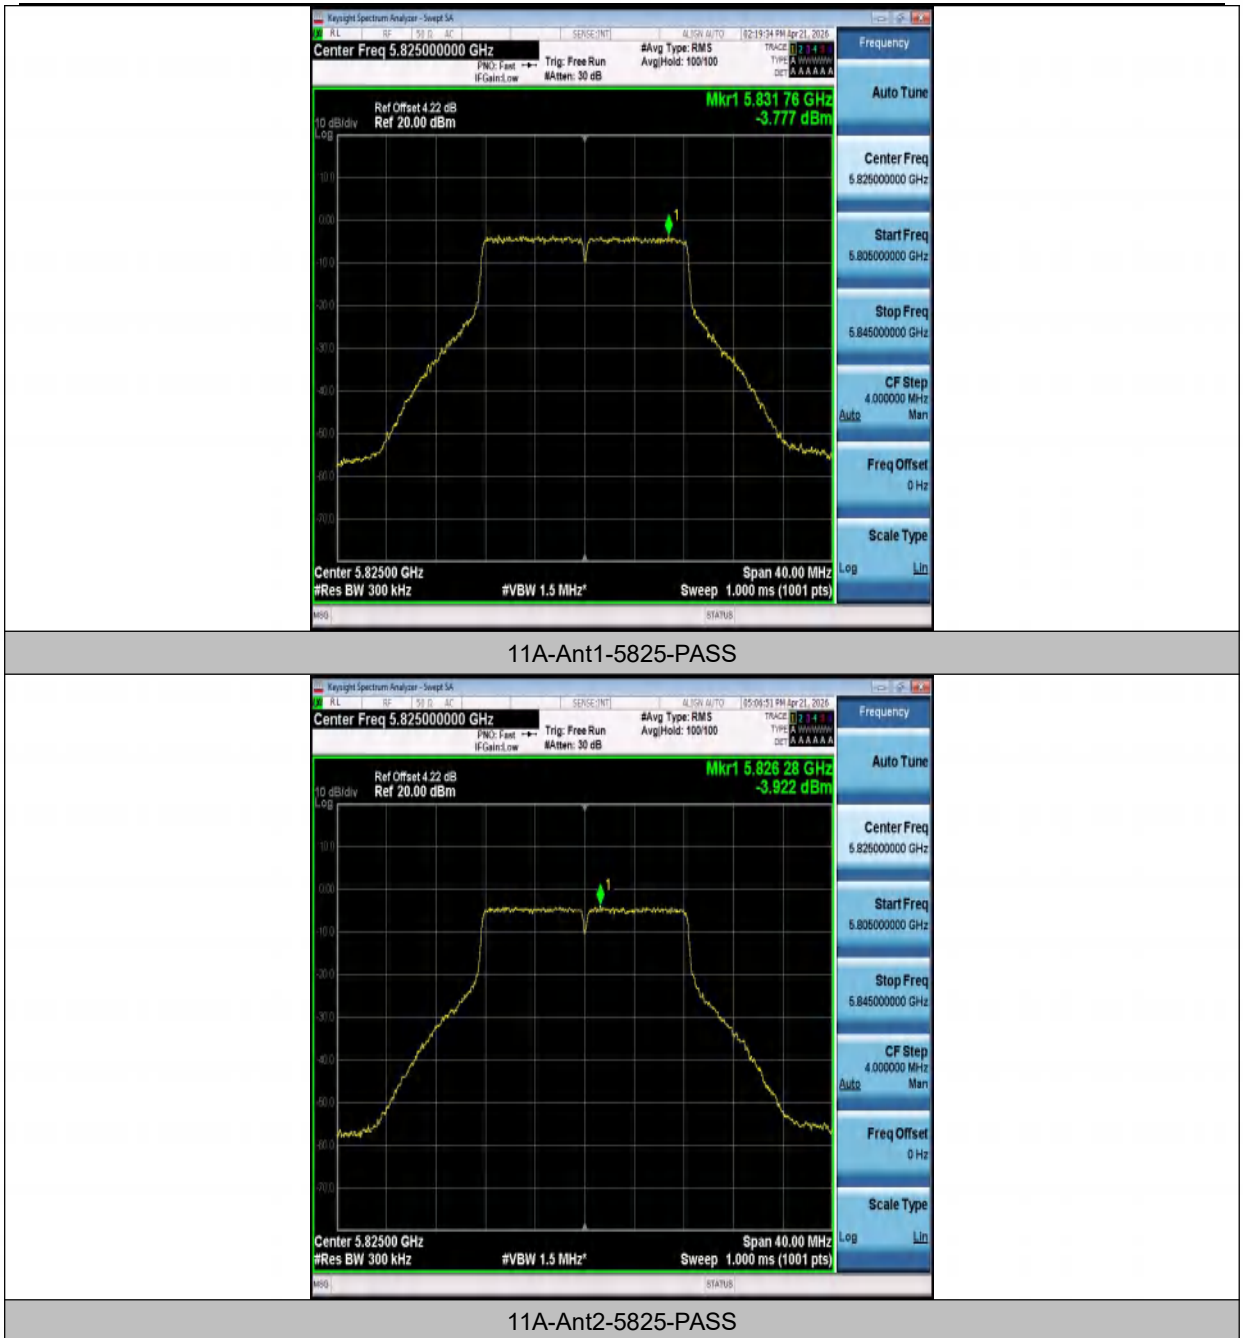

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

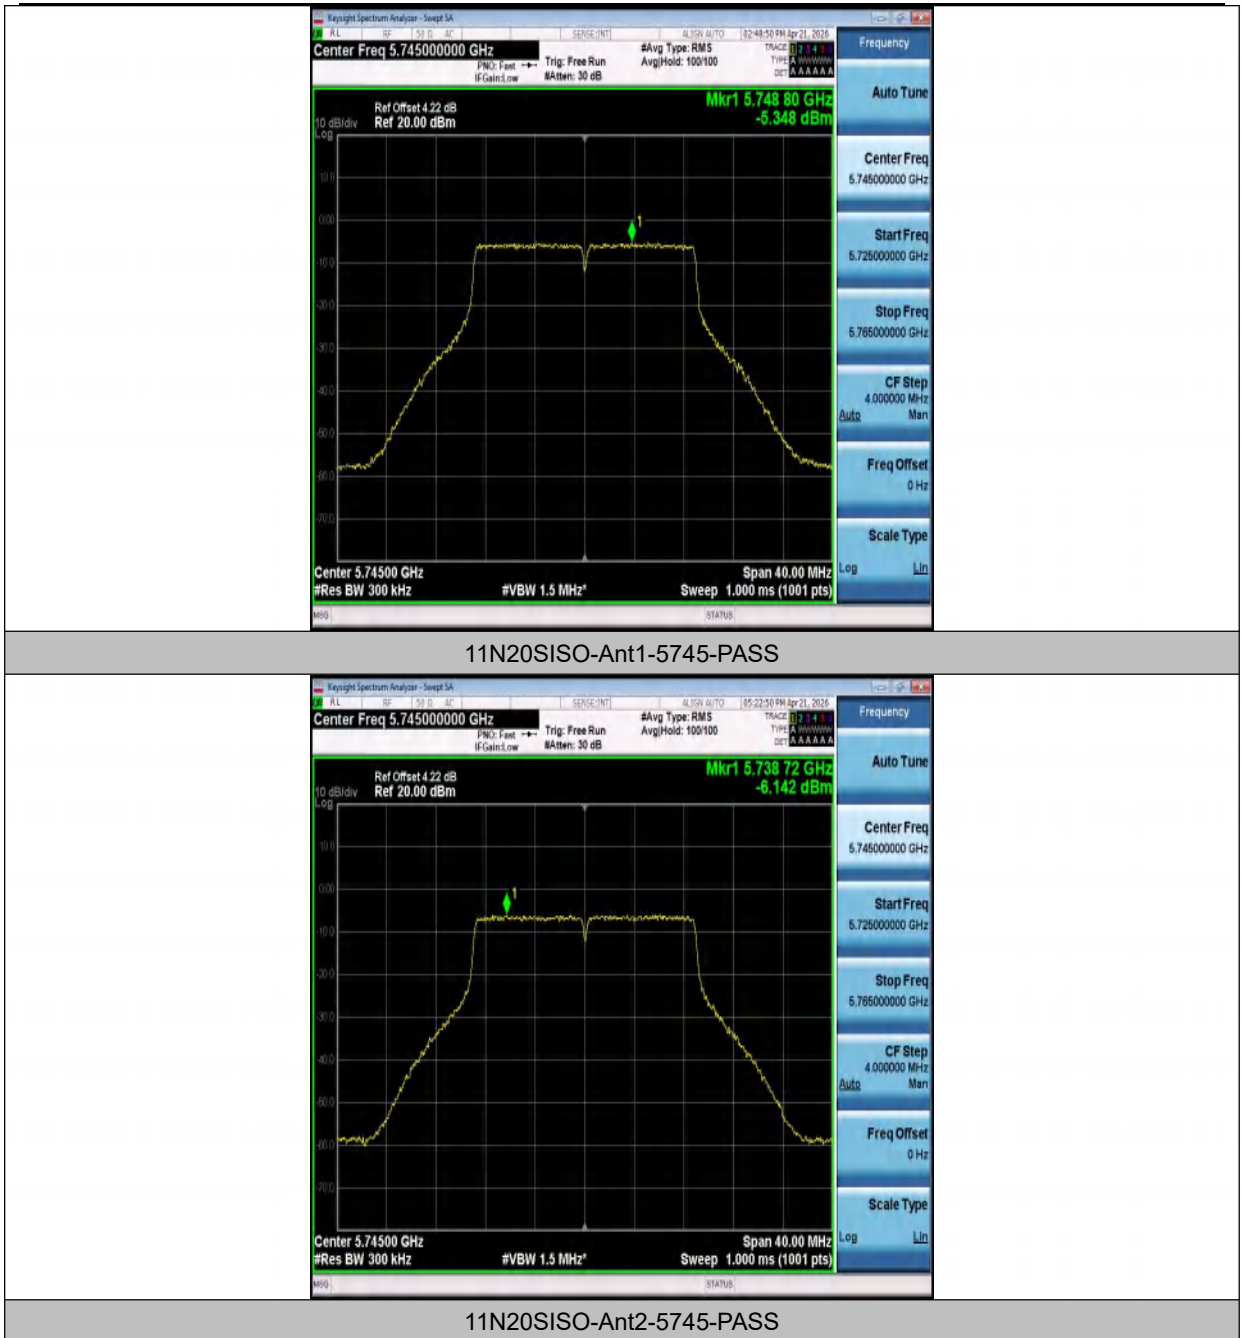

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

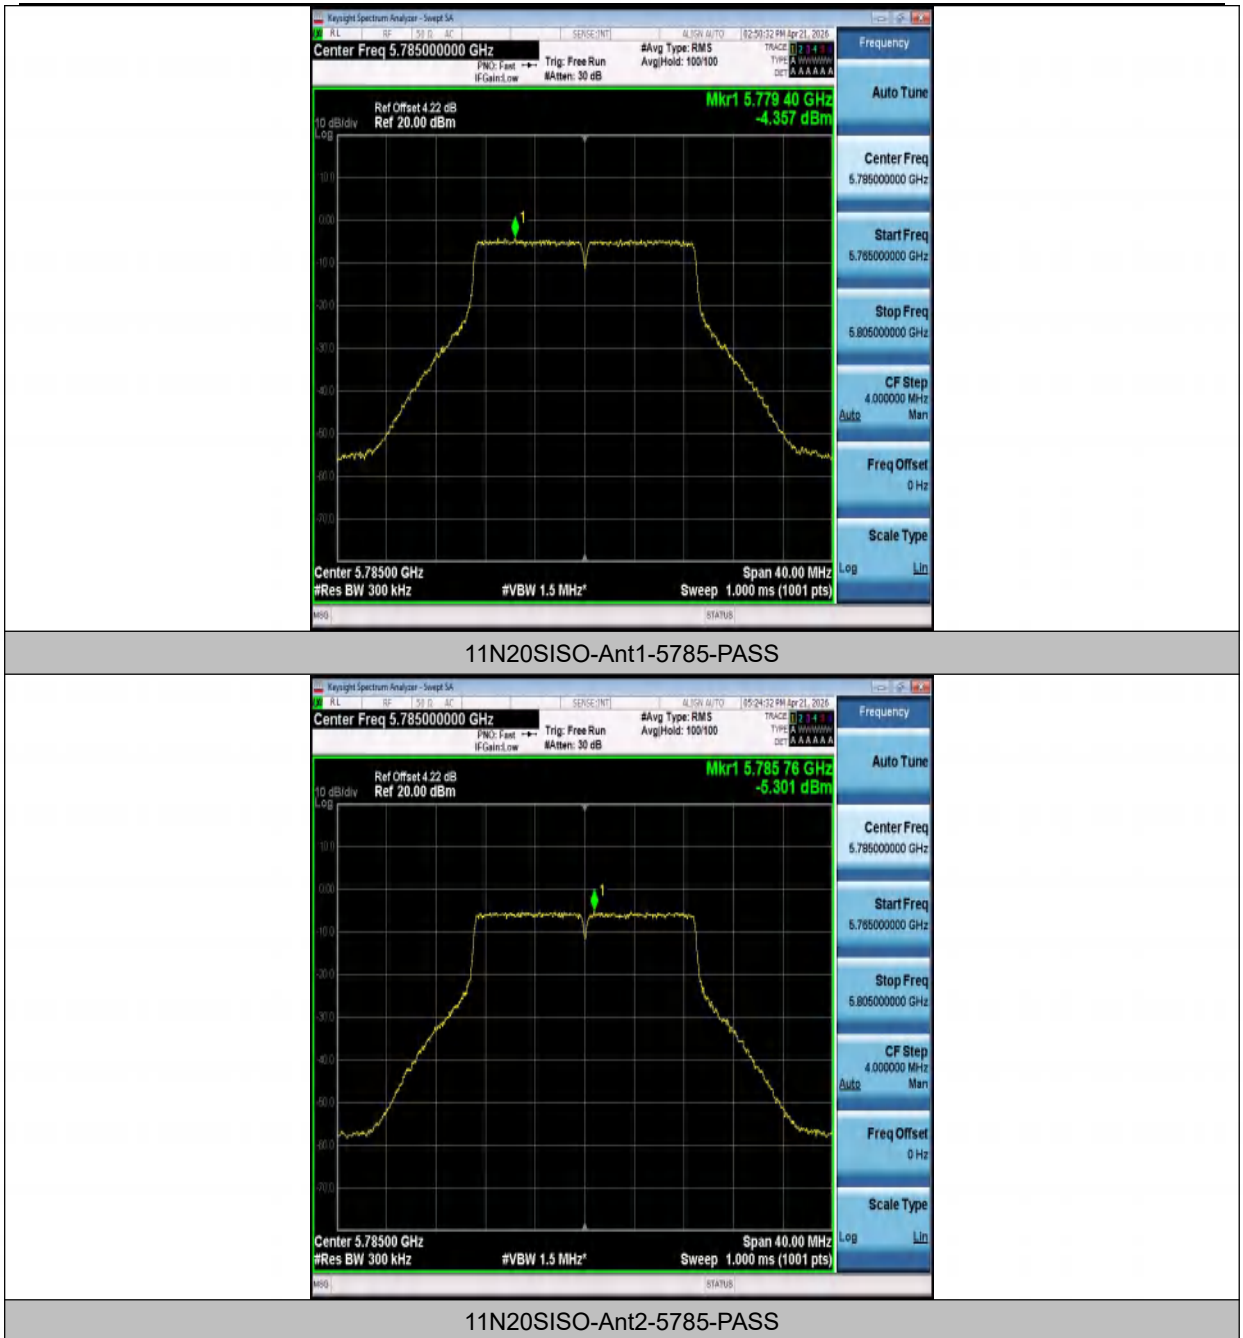

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

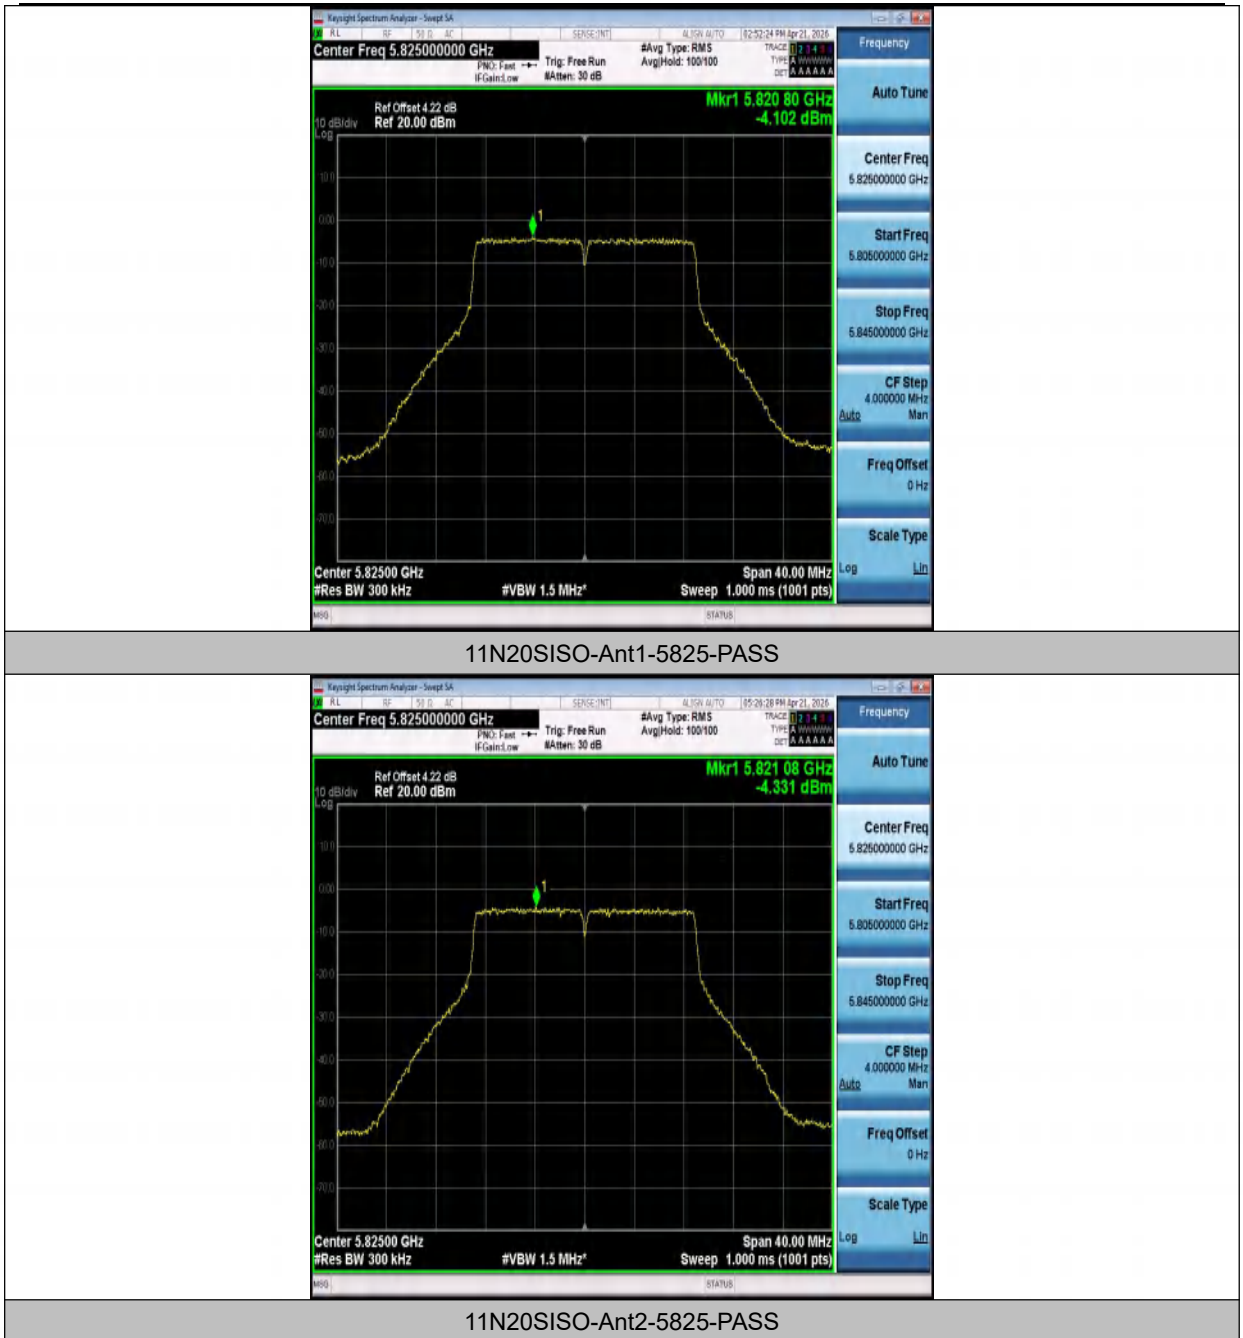

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

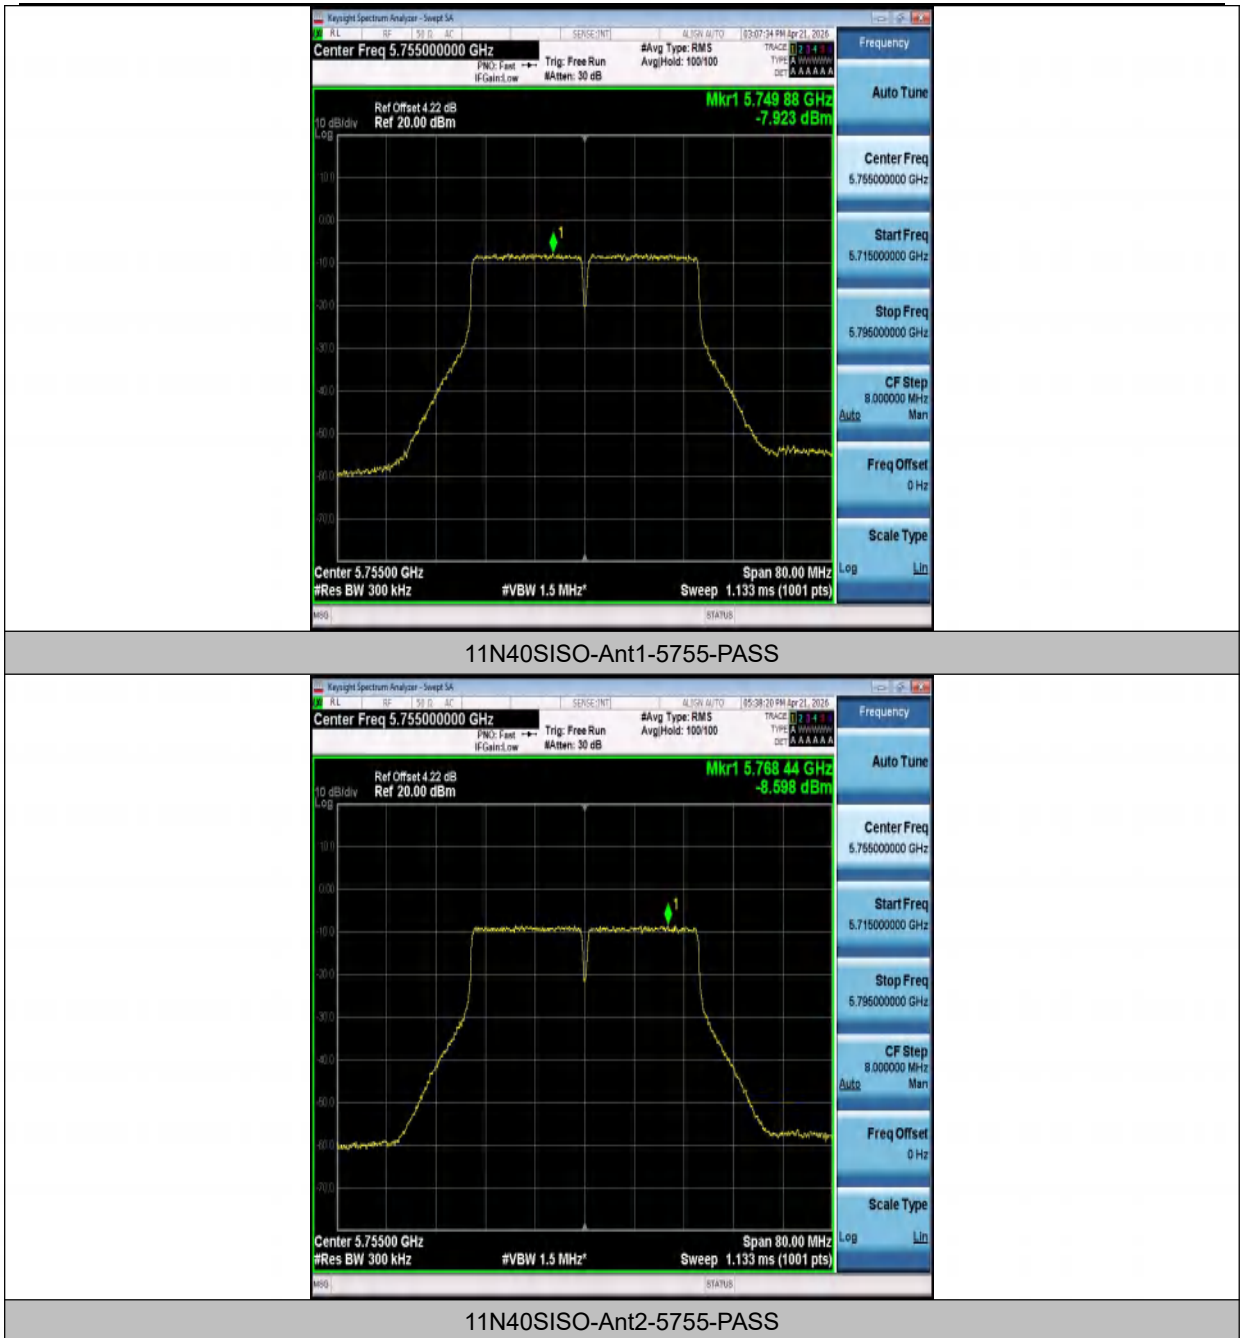

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

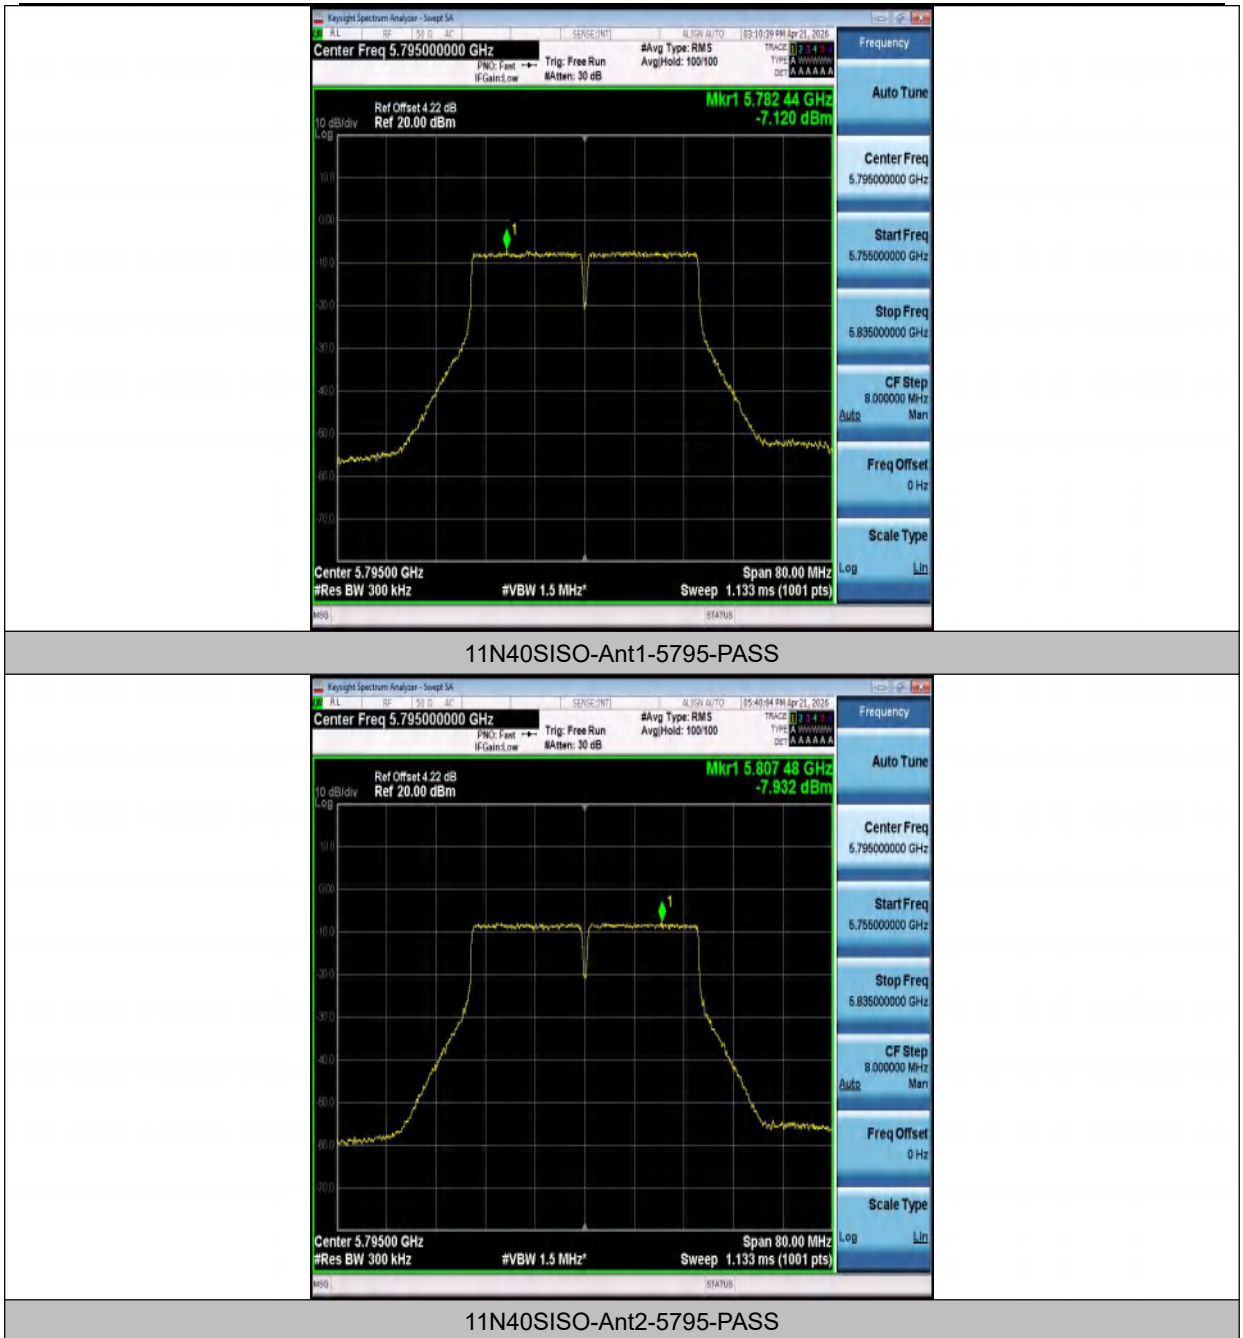

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

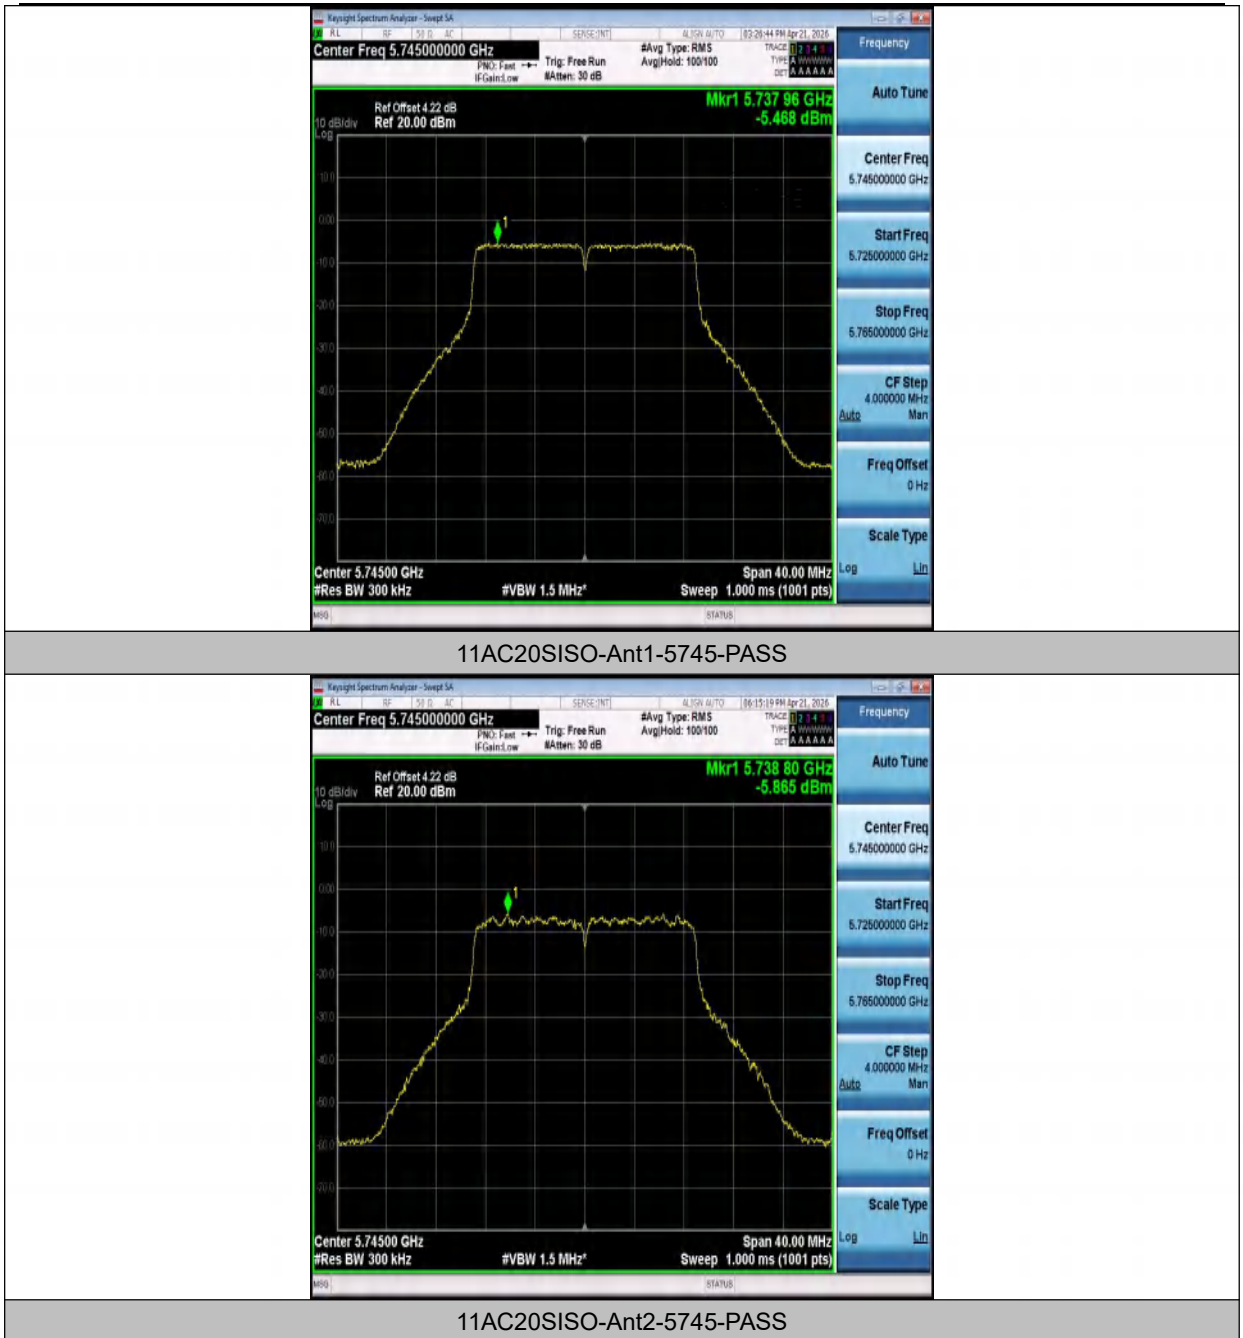

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

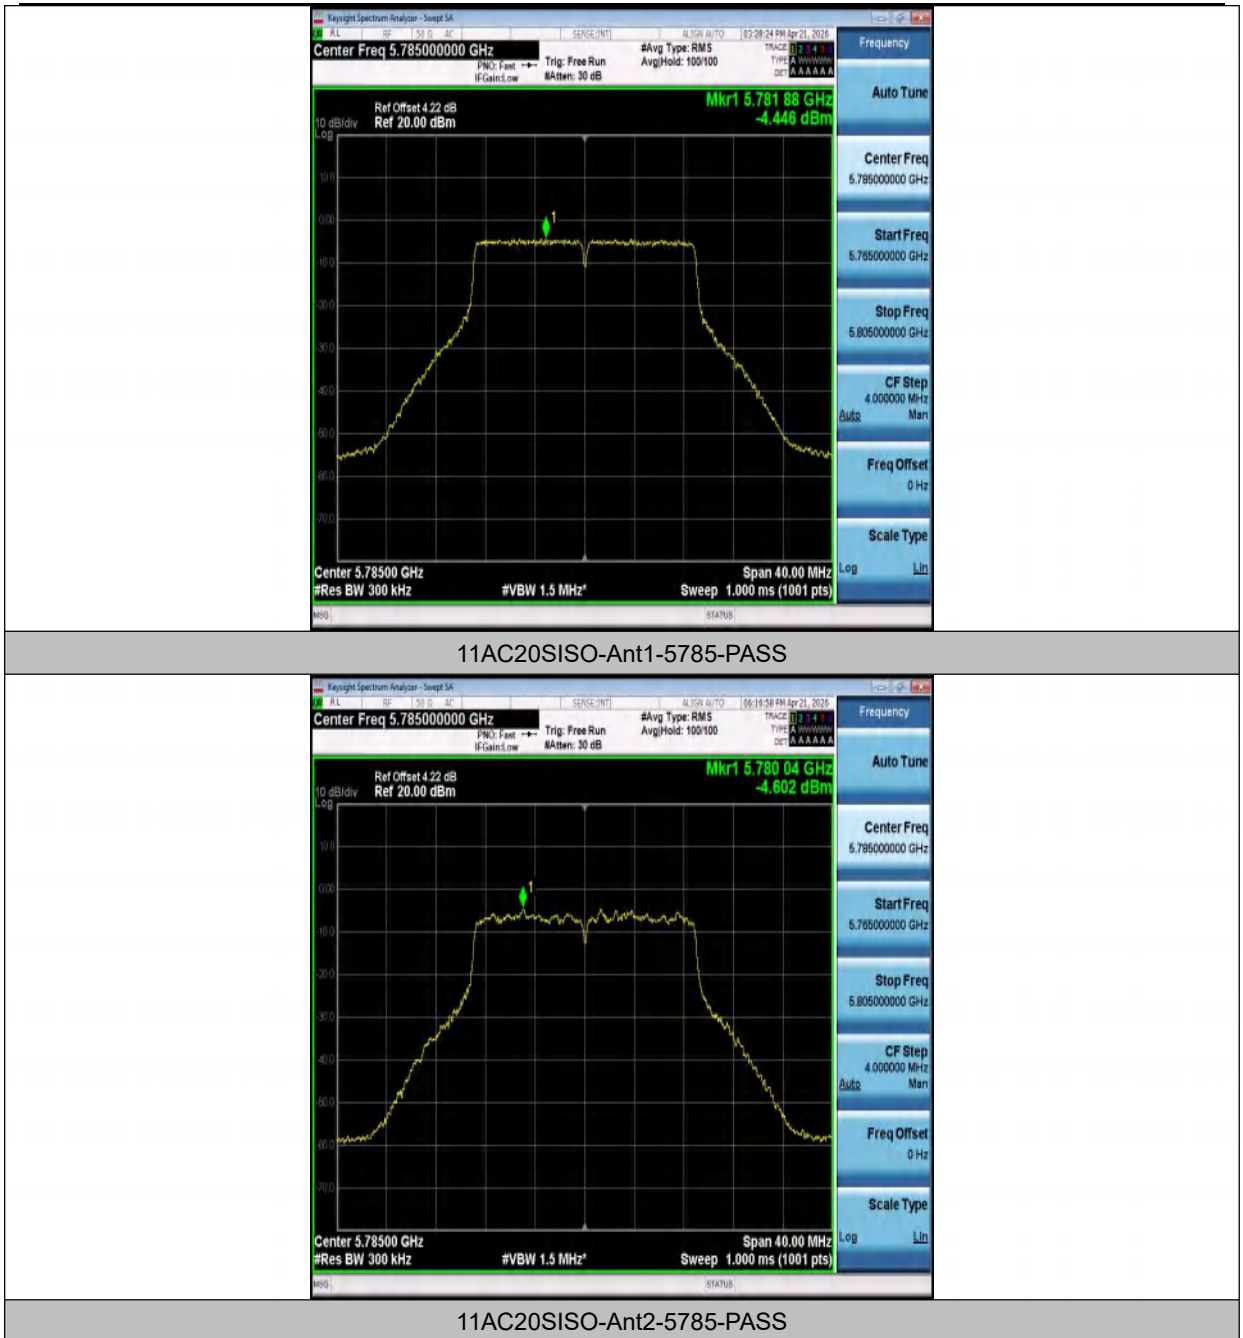

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

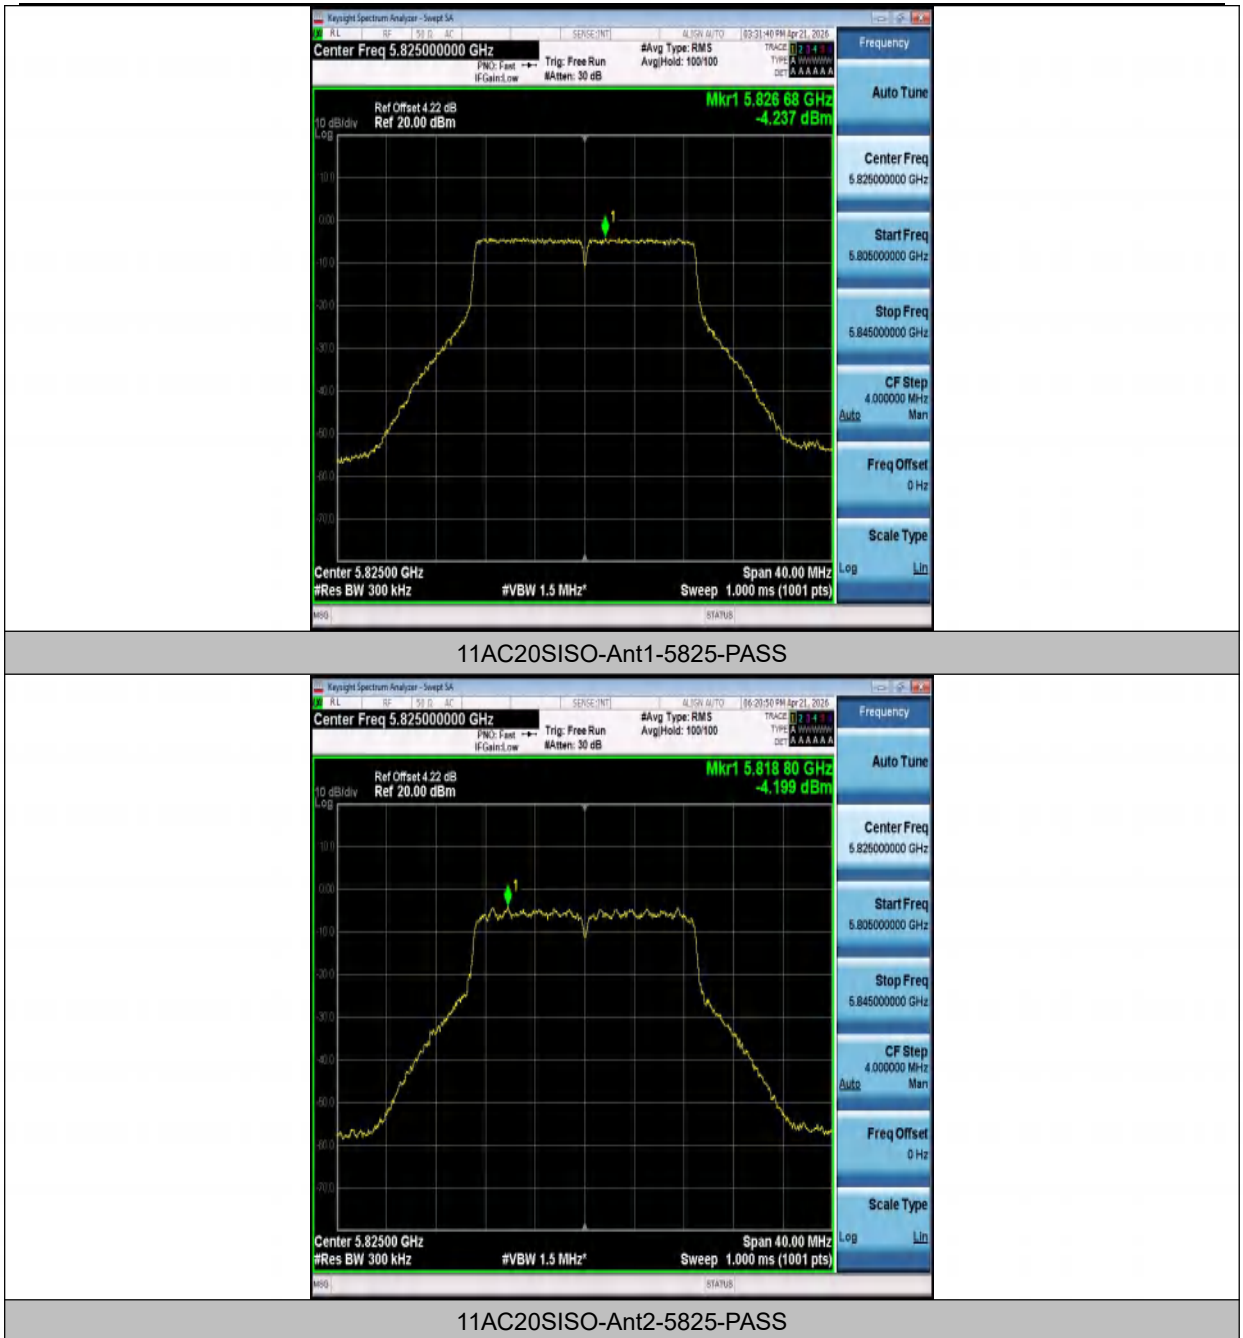

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

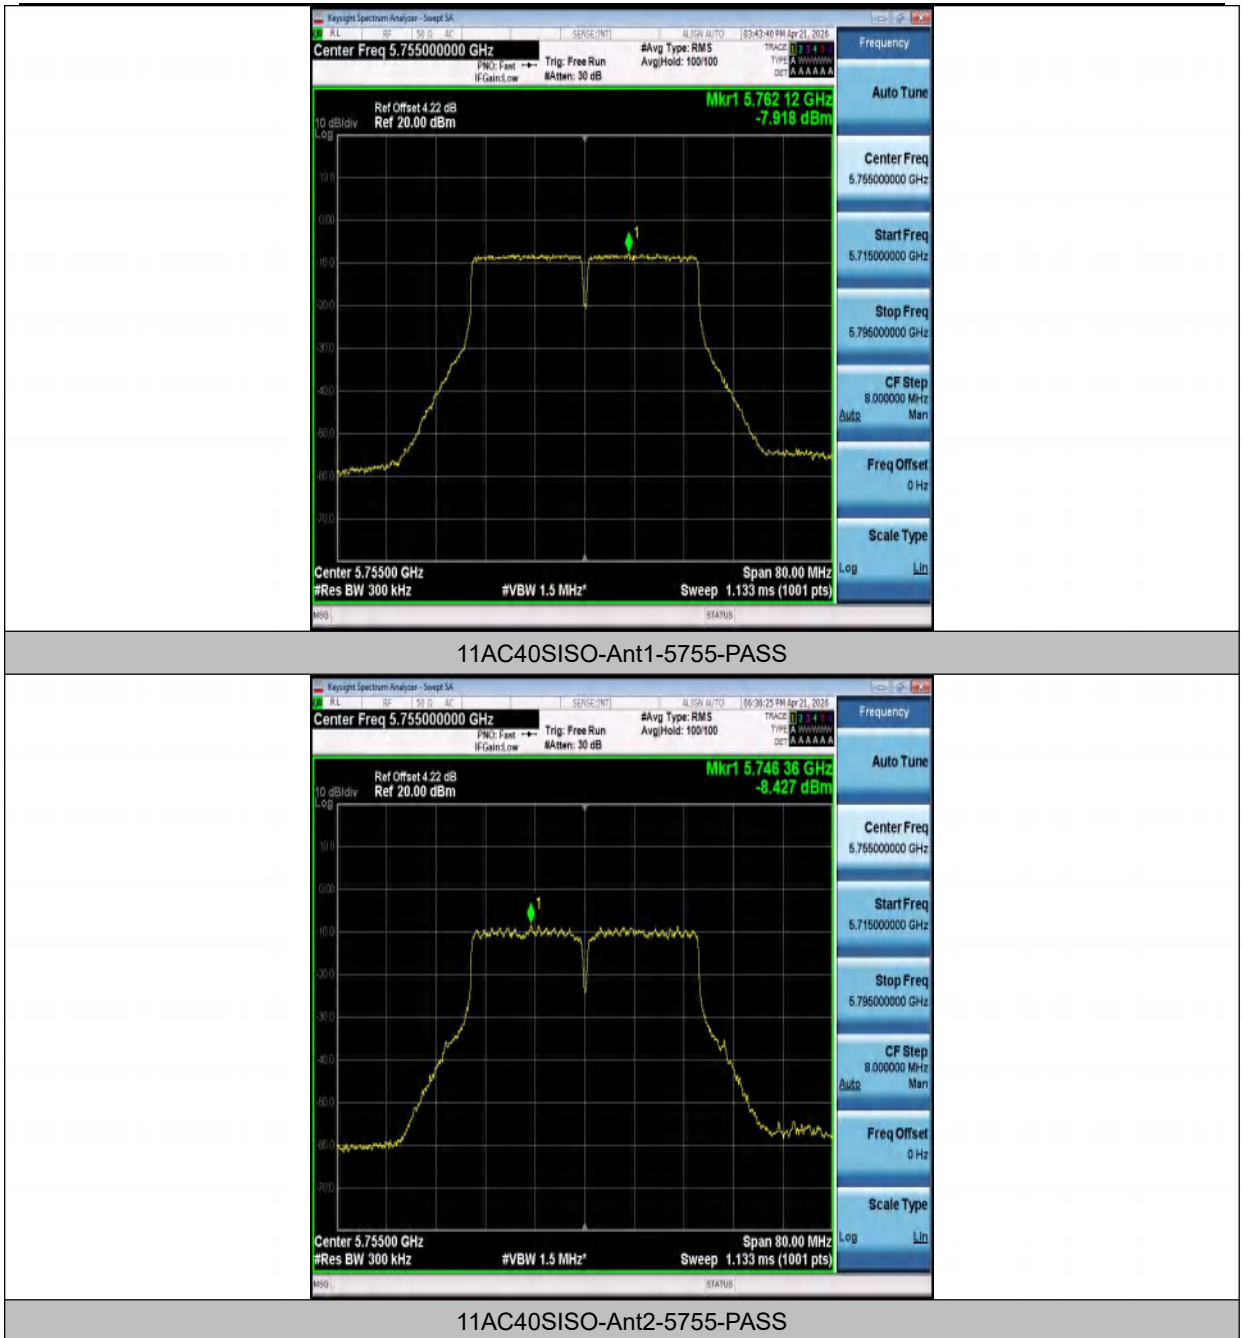

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

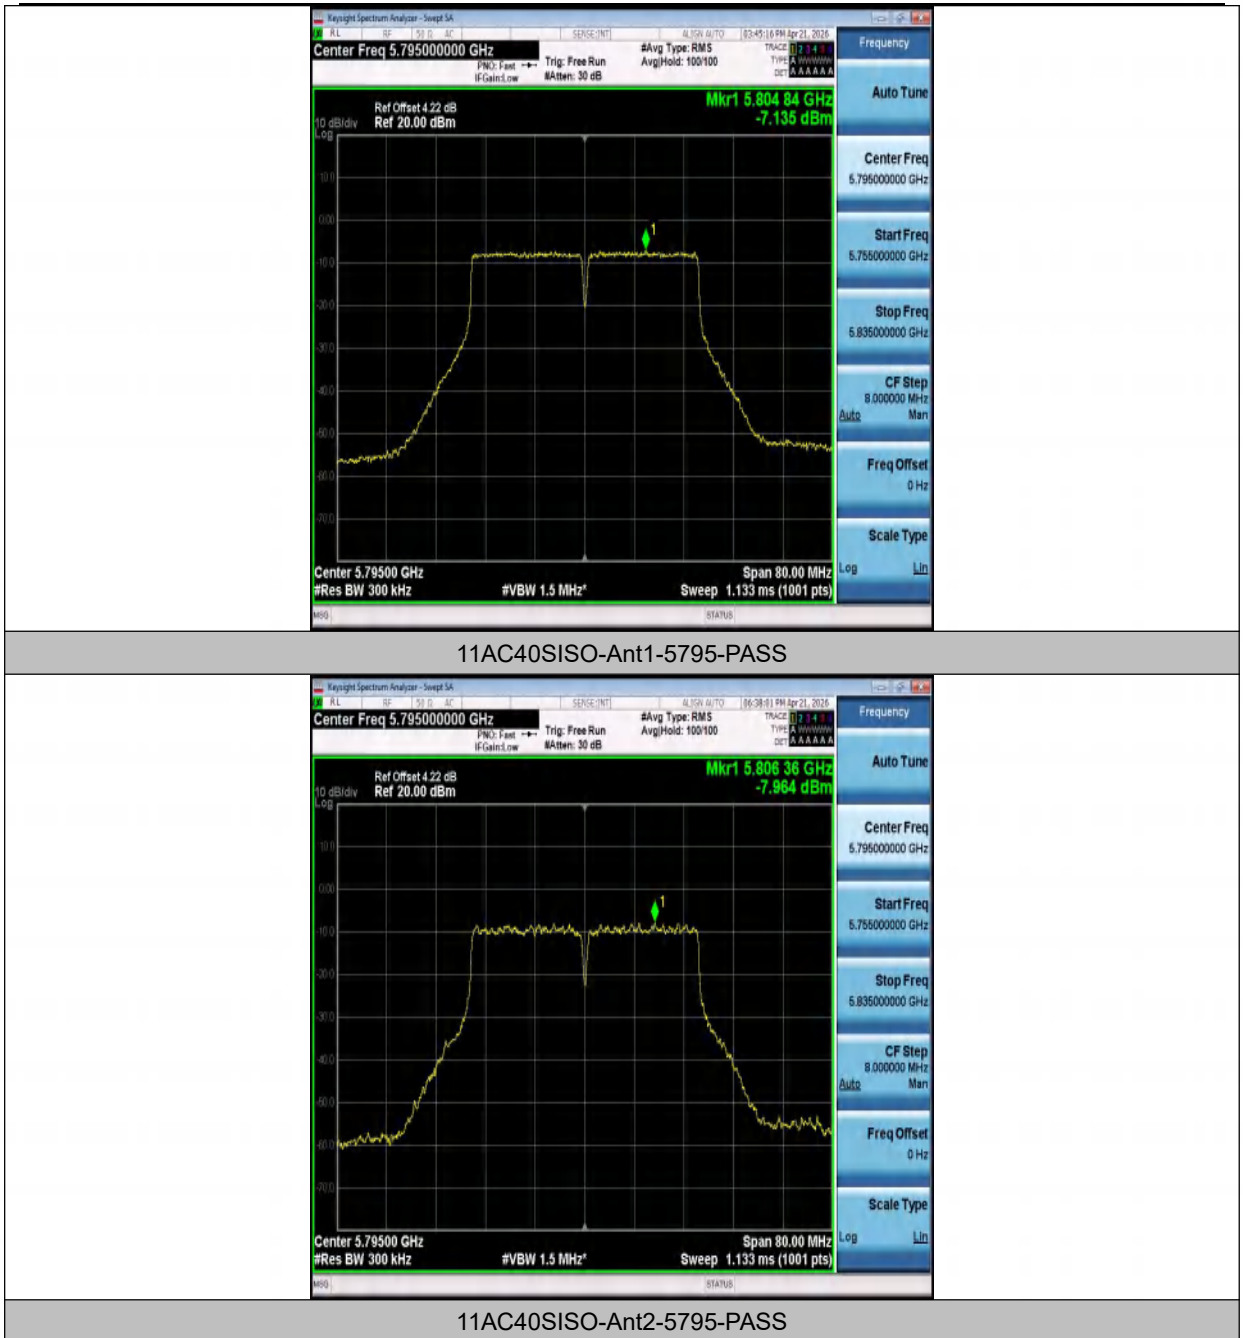

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

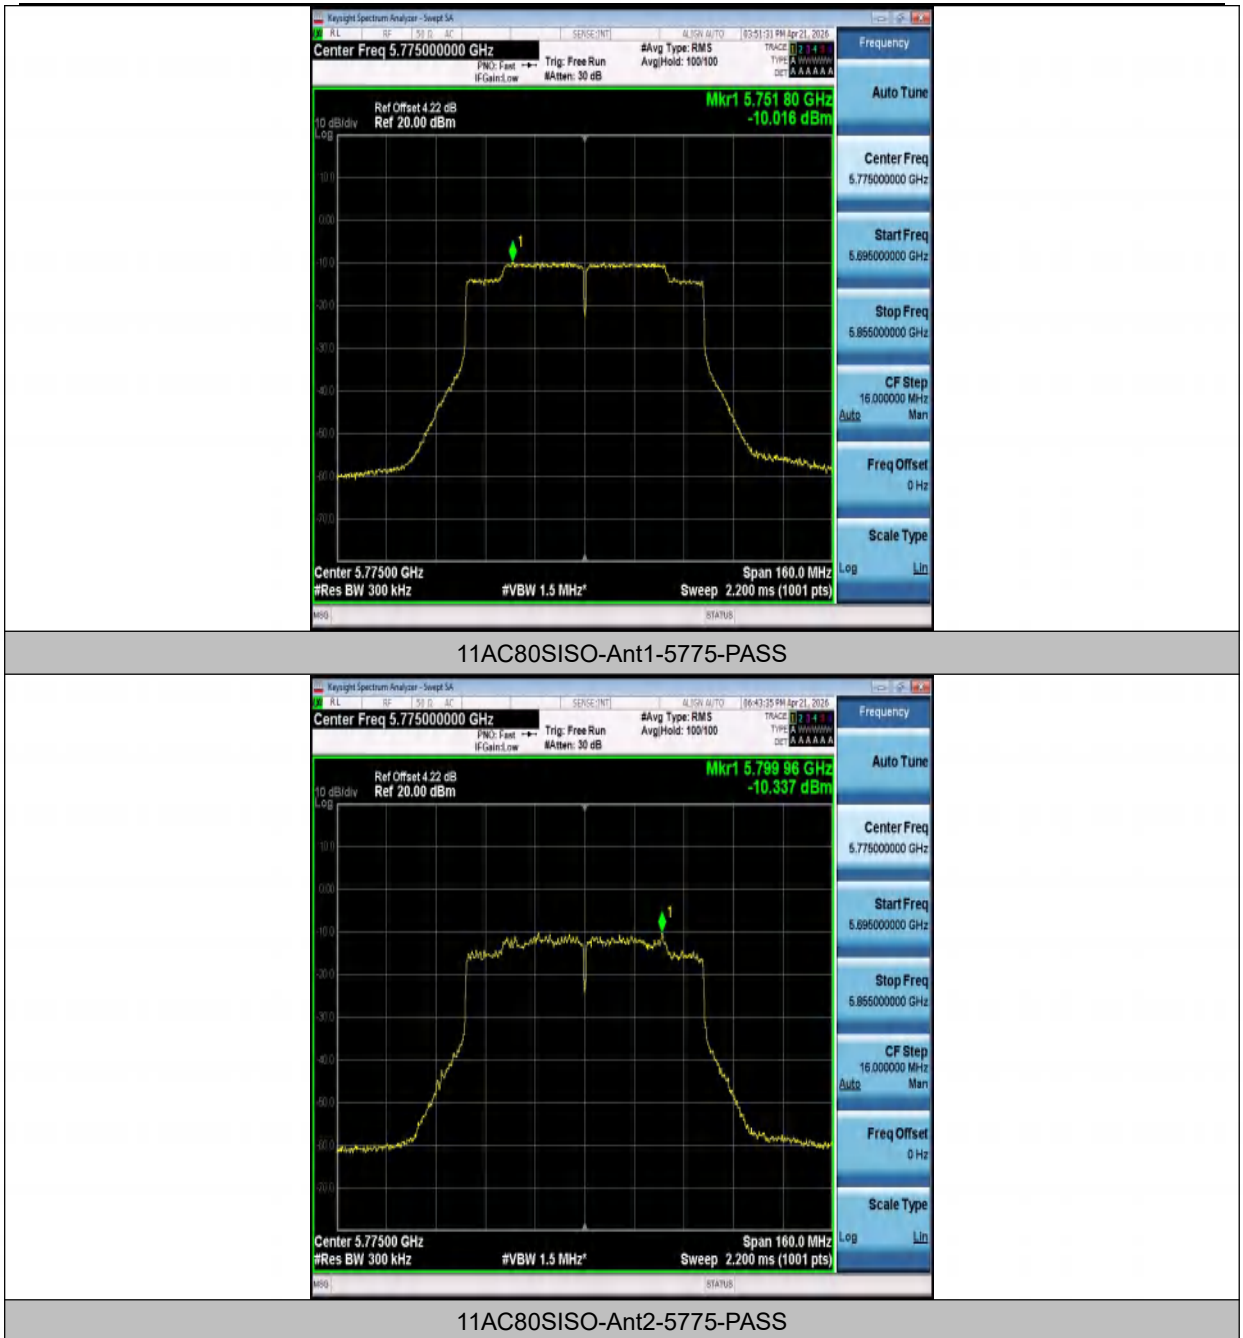

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

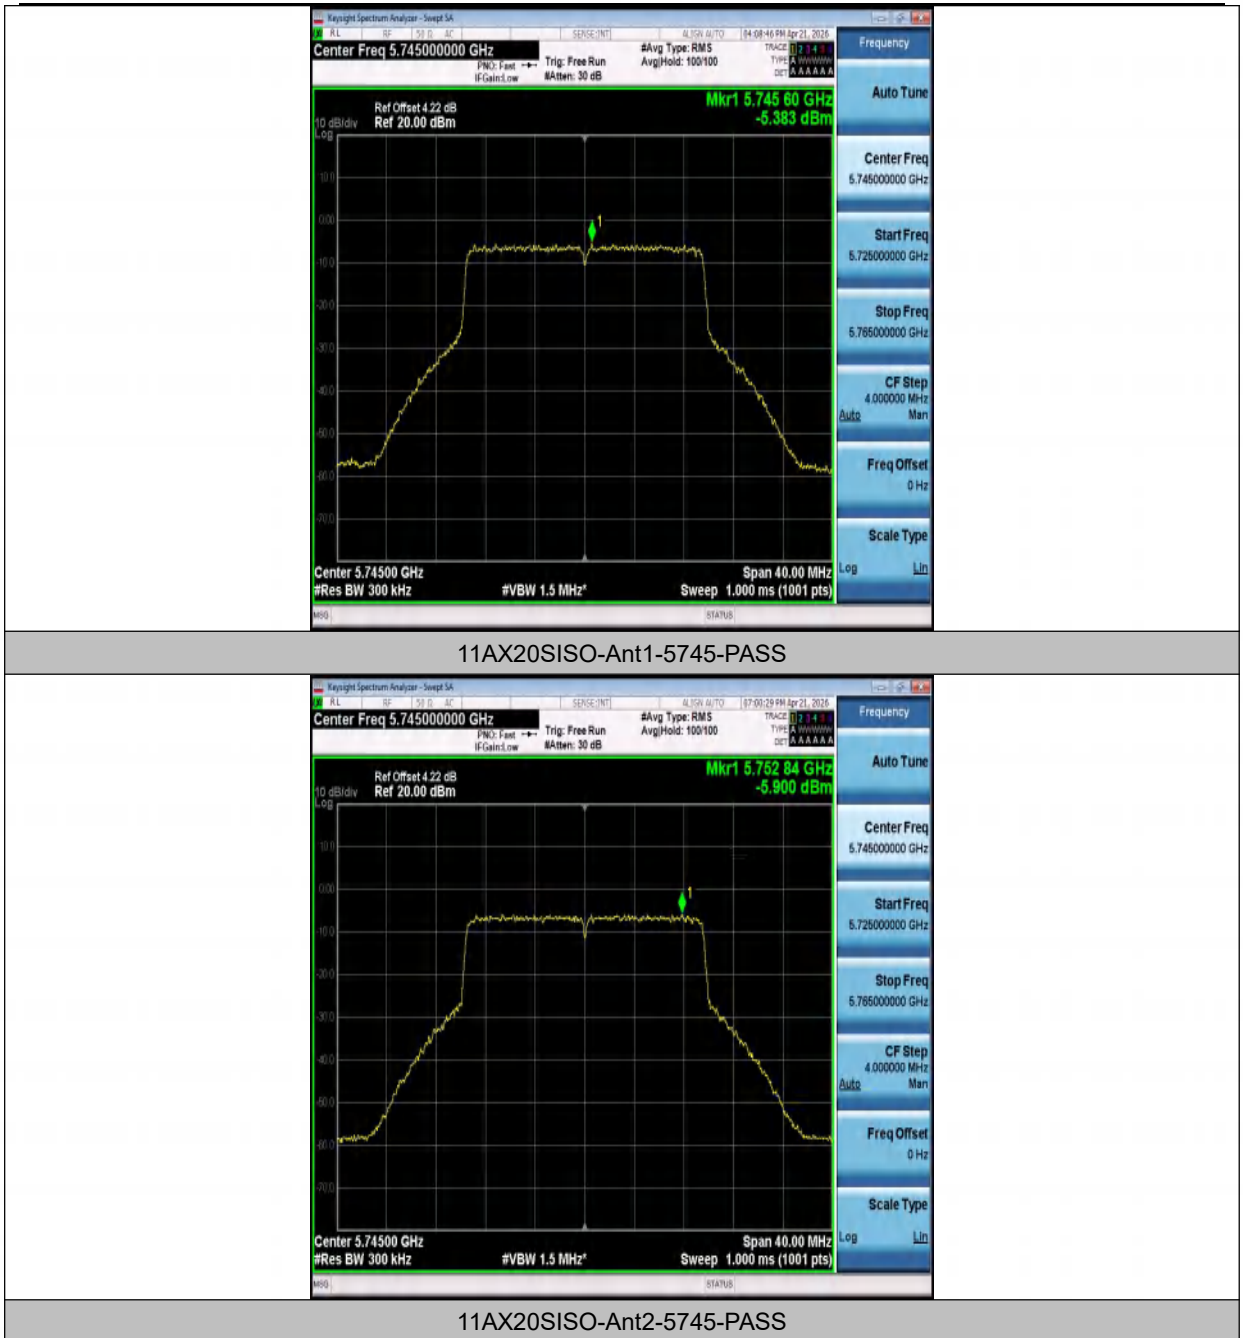

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

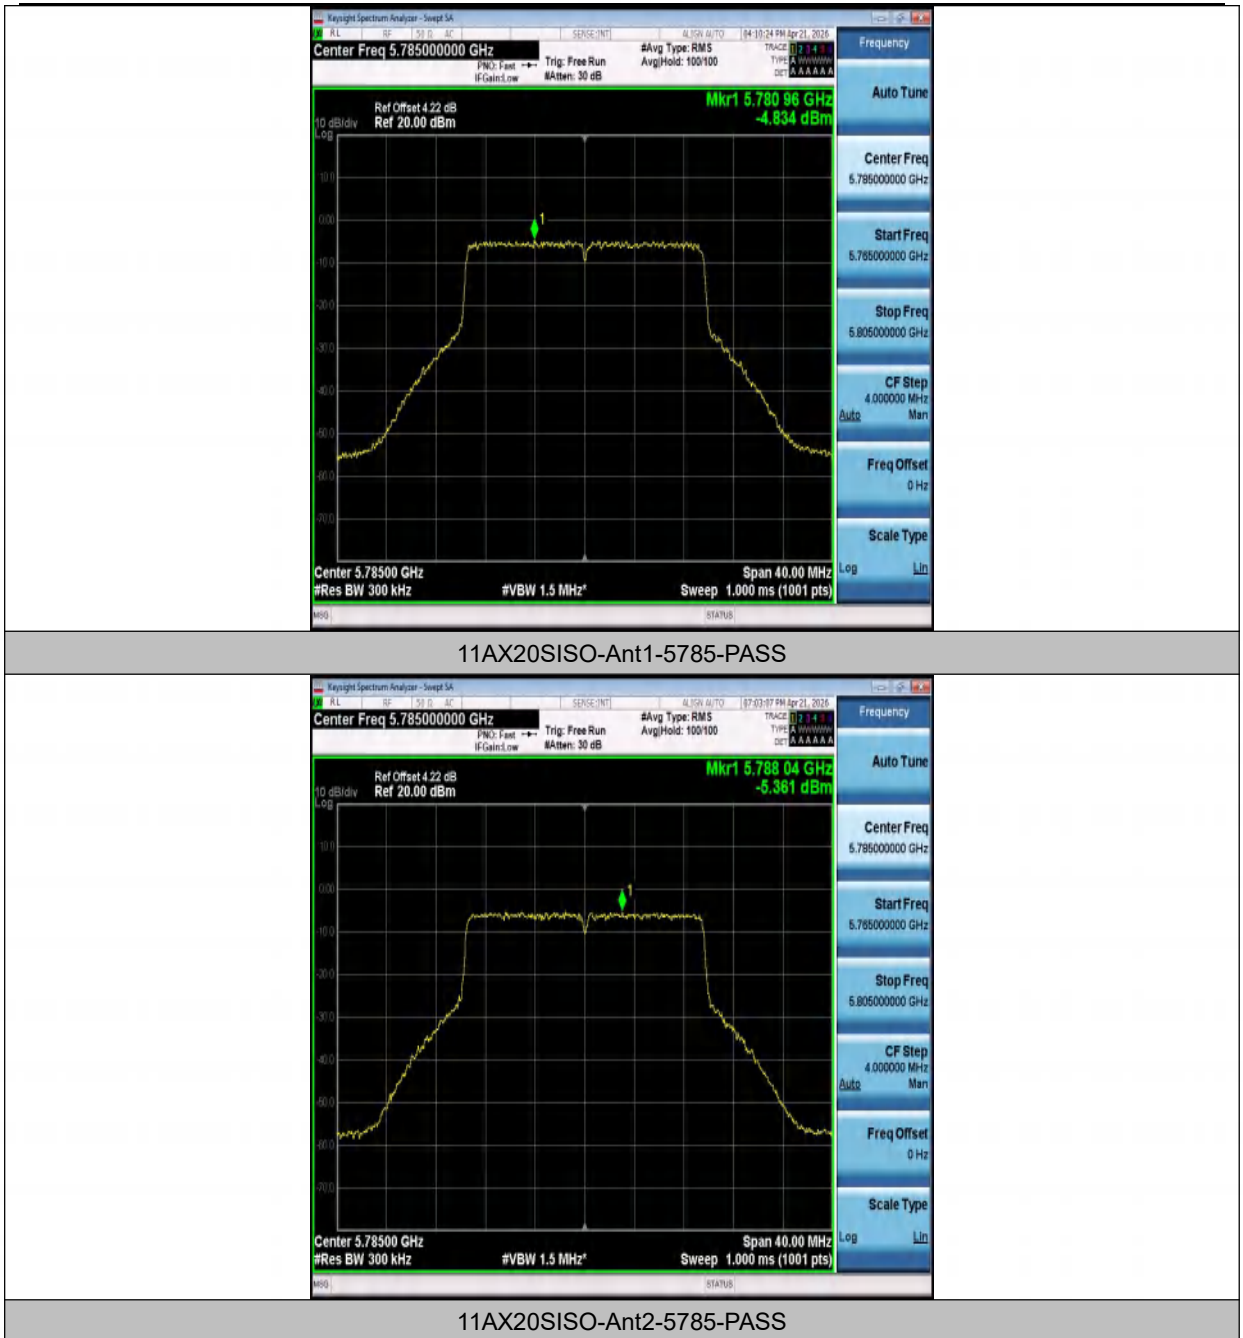

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

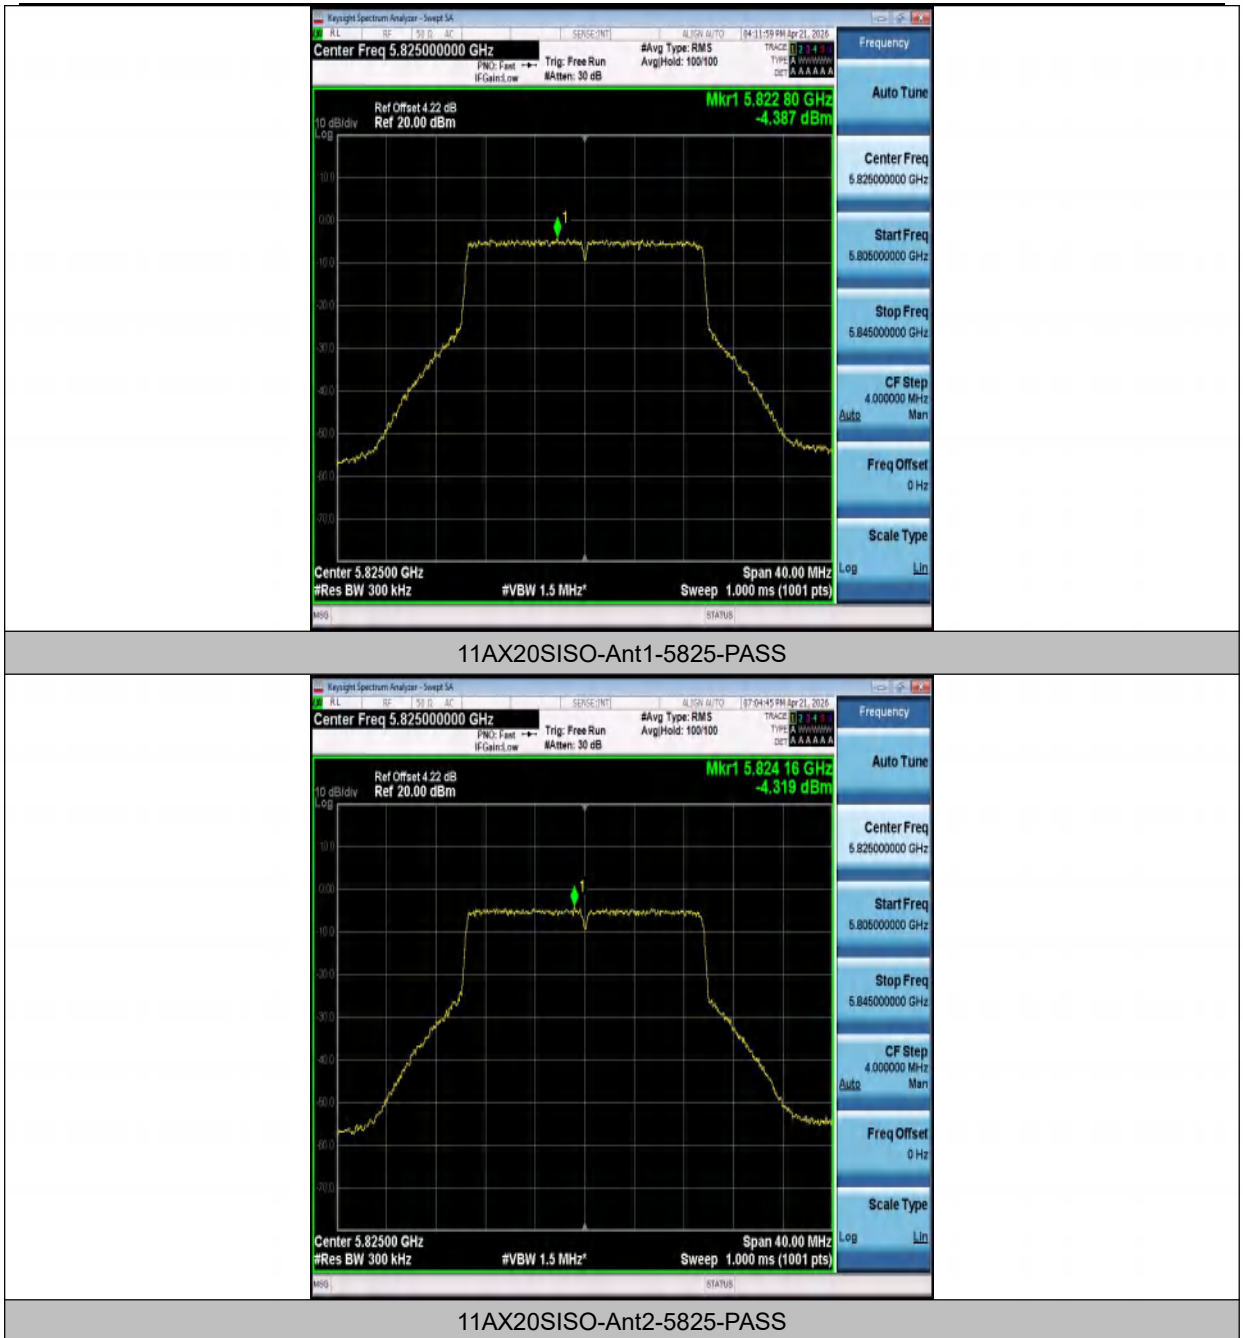

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

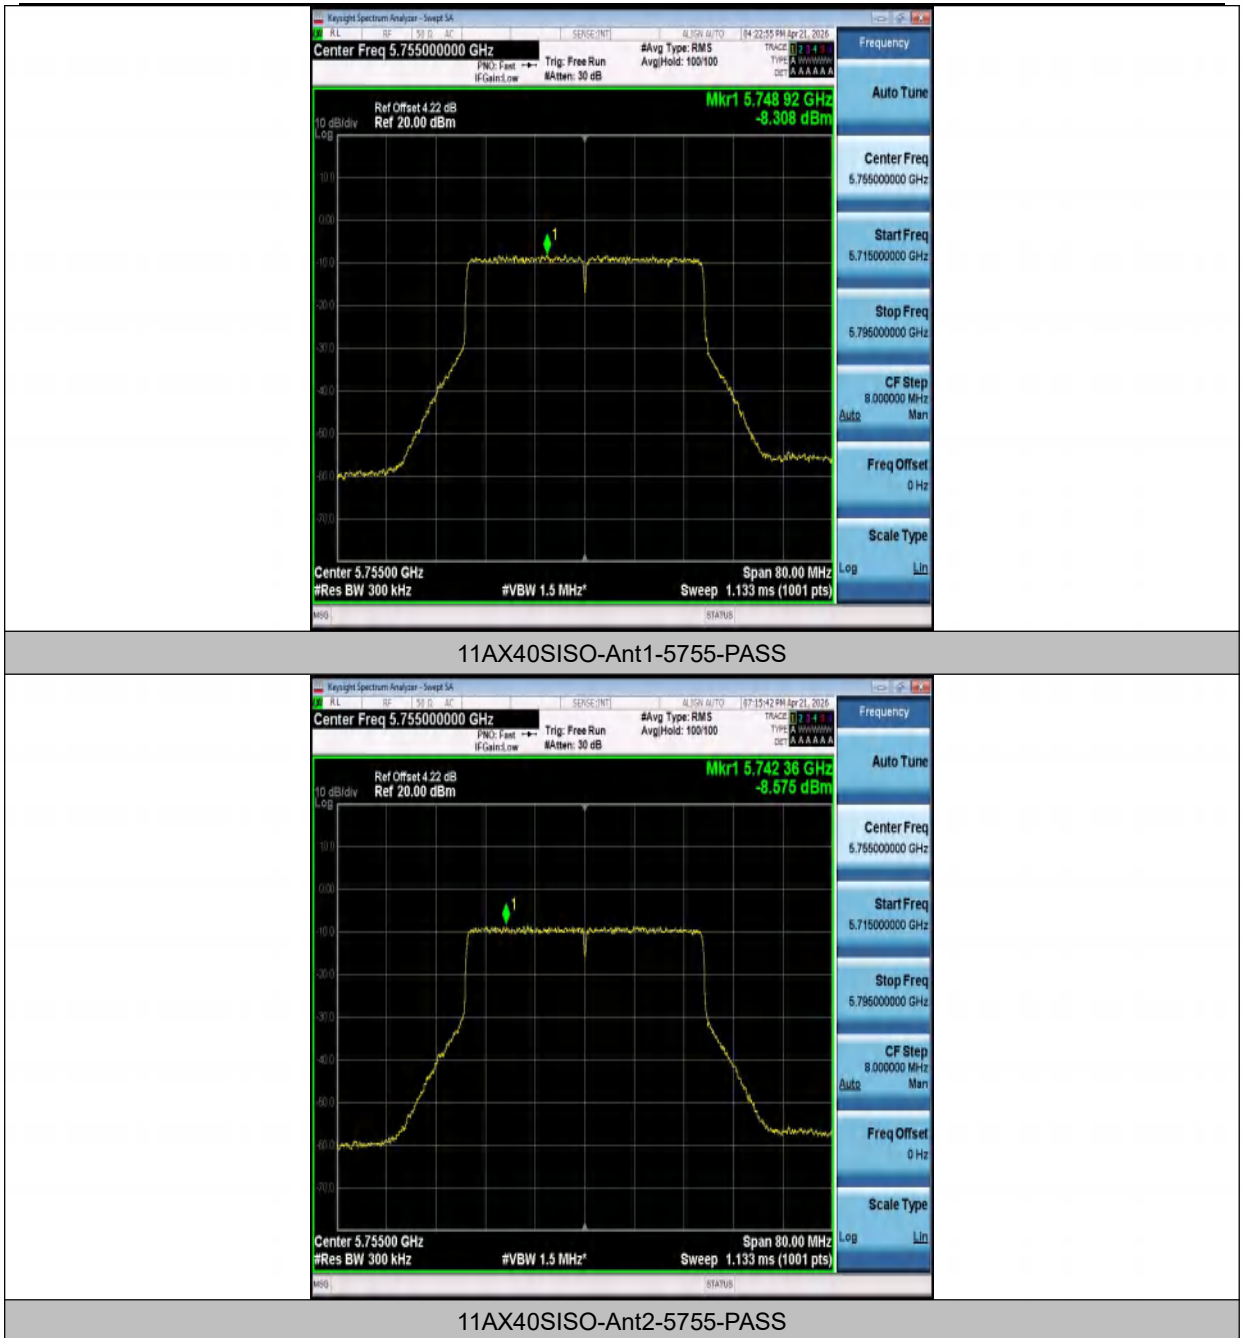

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

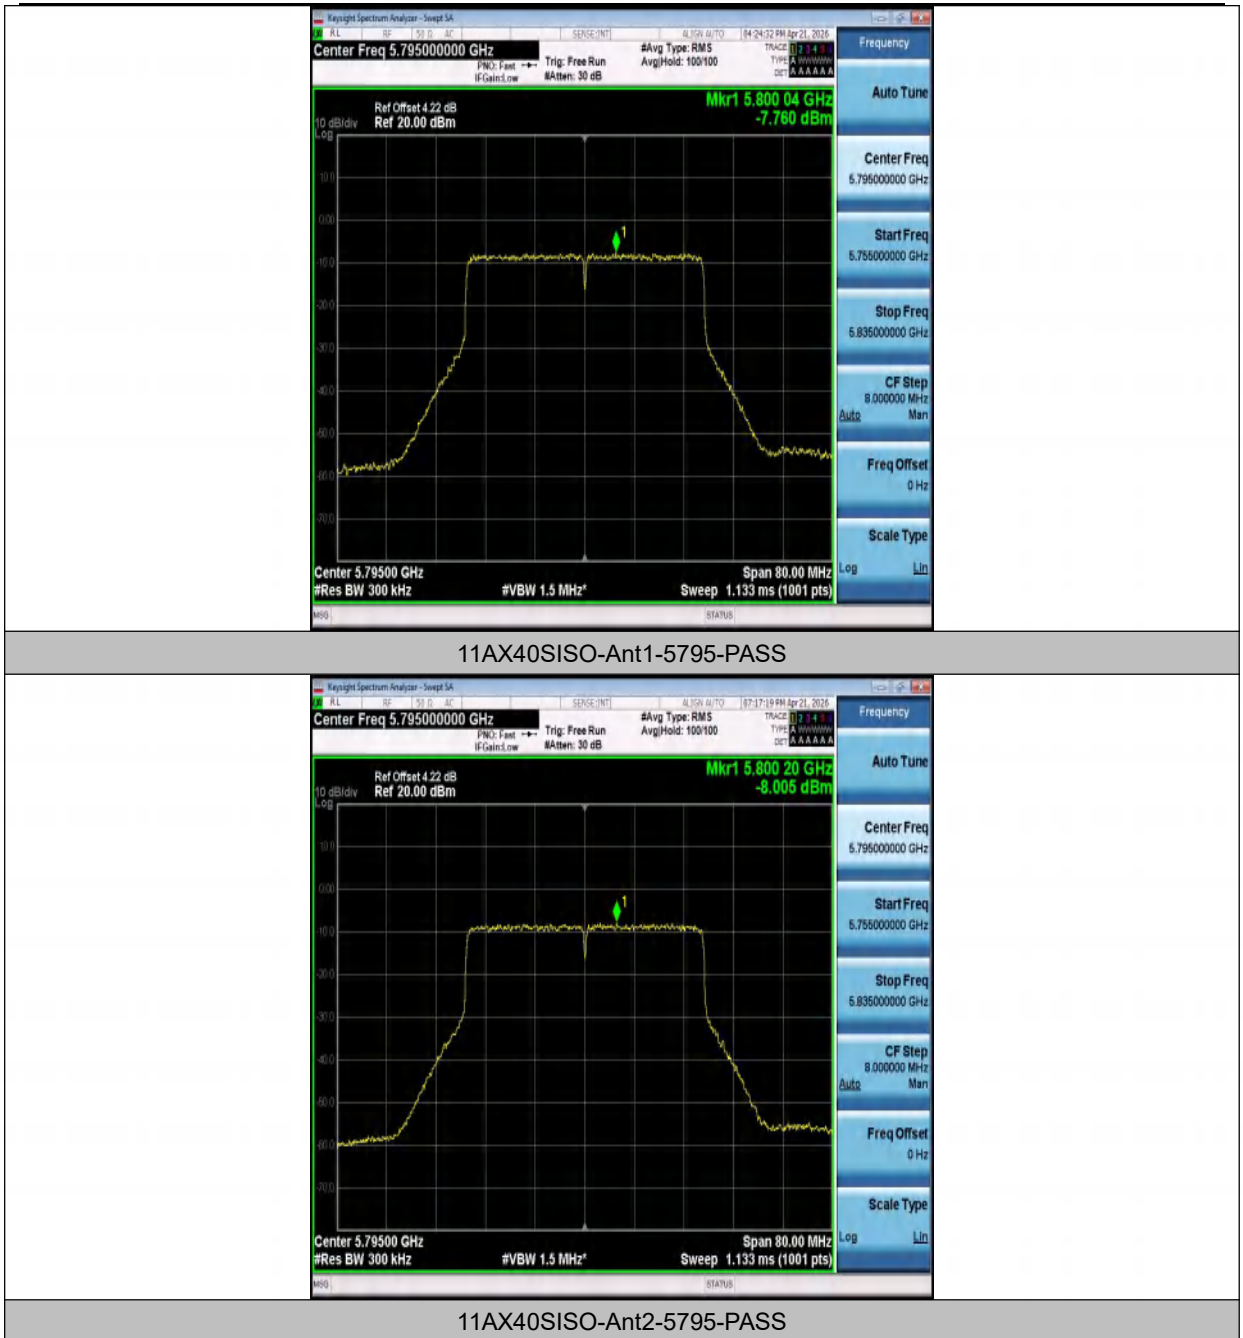

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



11AX80SISO-Ant1-5775-PASS



11AX80SISO-Ant2-5775-PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix E: Band edge measurements

Test Result B1/2/3

Test Mode	Antenna	ChName	Frequency[MHz]	Result[dBm]	Limit[dBm]	Verdict
11A	Ant1	Low	5180	-46.91	≤-27	PASS
11A	Ant2	Low	5180	-46.71	≤-27	PASS
11A	Ant1	High	5320	-45.26	≤-27	PASS
11A	Ant2	High	5320	-45.75	≤-27	PASS
11A	Ant1	Low	5500	-44.76	≤-27	PASS
11A	Ant2	Low	5500	-44.49	≤-27	PASS
11A	Ant1	High	5700	-44.75	≤-27	PASS
11A	Ant2	High	5700	-45.21	≤-27	PASS
11N20SISO	Ant1	Low	5180	-46.68	≤-27	PASS
11N20SISO	Ant2	Low	5180	-47.46	≤-27	PASS
11N20SISO	Ant1	High	5320	-45.52	≤-27	PASS
11N20SISO	Ant2	High	5320	-46.44	≤-27	PASS
11N20SISO	Ant1	Low	5500	-45.43	≤-27	PASS
11N20SISO	Ant2	Low	5500	-45.66	≤-27	PASS
11N20SISO	Ant1	High	5700	-44.92	≤-27	PASS
11N20SISO	Ant2	High	5700	-44.28	≤-27	PASS
11N40SISO	Ant1	Low	5190	-46.96	≤-27	PASS
11N40SISO	Ant2	Low	5190	-46.66	≤-27	PASS
11N40SISO	Ant1	High	5310	-44.28	≤-27	PASS
11N40SISO	Ant2	High	5310	-45.76	≤-27	PASS
11N40SISO	Ant1	Low	5510	-45.33	≤-27	PASS
11N40SISO	Ant2	Low	5510	-45.91	≤-27	PASS
11N40SISO	Ant1	High	5670	-45.97	≤-27	PASS
11N40SISO	Ant2	High	5670	-45.56	≤-27	PASS
11AC20SISO	Ant1	Low	5180	-46.95	≤-27	PASS
11AC20SISO	Ant2	Low	5180	-47.02	≤-27	PASS
11AC20SISO	Ant1	High	5320	-45.52	≤-27	PASS
11AC20SISO	Ant2	High	5320	-46.98	≤-27	PASS
11AC20SISO	Ant1	Low	5500	-44.74	≤-27	PASS
11AC20SISO	Ant2	Low	5500	-46.06	≤-27	PASS
11AC20SISO	Ant1	High	5700	-44.47	≤-27	PASS
11AC20SISO	Ant2	High	5700	-44.79	≤-27	PASS
11AC40SISO	Ant1	Low	5190	-46.34	≤-27	PASS
11AC40SISO	Ant2	Low	5190	-46.46	≤-27	PASS
11AC40SISO	Ant1	High	5310	-45.49	≤-27	PASS
11AC40SISO	Ant2	High	5310	-46.16	≤-27	PASS
11AC40SISO	Ant1	Low	5510	-45.19	≤-27	PASS

11AC40SISO	Ant2	Low	5510	-45.58	≤ -27	PASS
11AC40SISO	Ant1	High	5670	-44.87	≤ -27	PASS
11AC40SISO	Ant2	High	5670	-45.78	≤ -27	PASS
11AC80SISO	Ant1	Low	5210	-43.46	≤ -27	PASS
11AC80SISO	Ant2	Low	5210	-42.98	≤ -27	PASS
11AC80SISO	Ant1	High	5290	-39.42	≤ -27	PASS
11AC80SISO	Ant2	High	5290	-41.35	≤ -27	PASS
11AC80SISO	Ant1	Low	5530	-44.11	≤ -27	PASS
11AC80SISO	Ant2	Low	5530	-41.98	≤ -27	PASS
11AC80SISO	Ant1	High	5610	-46.26	≤ -27	PASS
11AC80SISO	Ant2	High	5610	-44	≤ -27	PASS
11AX20SISO	Ant1	Low	5180	-46.1	≤ -27	PASS
11AX20SISO	Ant2	Low	5180	-46.81	≤ -27	PASS
11AX20SISO	Ant1	High	5320	-45.13	≤ -27	PASS
11AX20SISO	Ant2	High	5320	-45.82	≤ -27	PASS
11AX20SISO	Ant1	Low	5500	-45.24	≤ -27	PASS
11AX20SISO	Ant2	Low	5500	-45.68	≤ -27	PASS
11AX20SISO	Ant1	High	5700	-41.71	≤ -27	PASS
11AX20SISO	Ant2	High	5700	-42.02	≤ -27	PASS
11AX40SISO	Ant1	Low	5190	-45.72	≤ -27	PASS
11AX40SISO	Ant2	Low	5190	-47.12	≤ -27	PASS
11AX40SISO	Ant1	High	5310	-45.4	≤ -27	PASS
11AX40SISO	Ant2	High	5310	-45.44	≤ -27	PASS
11AX40SISO	Ant1	Low	5510	-45.27	≤ -27	PASS
11AX40SISO	Ant2	Low	5510	-45.94	≤ -27	PASS
11AX40SISO	Ant1	High	5670	-45.13	≤ -27	PASS
11AX40SISO	Ant2	High	5670	-45.46	≤ -27	PASS
11AX80SISO	Ant1	Low	5210	-46.32	≤ -27	PASS
11AX80SISO	Ant2	Low	5210	-45.57	≤ -27	PASS
11AX80SISO	Ant1	High	5290	-44.19	≤ -27	PASS
11AX80SISO	Ant2	High	5290	-46.3	≤ -27	PASS
11AX80SISO	Ant1	Low	5530	-44.62	≤ -27	PASS
11AX80SISO	Ant2	Low	5530	-45.11	≤ -27	PASS
11AX80SISO	Ant1	High	5610	-45.88	≤ -27	PASS
11AX80SISO	Ant2	High	5610	-45.92	≤ -27	PASS

Note: The margin plus the antenna gain also meets the limit.

Test Result B4

Test Mode	Antenna	Ch. Name	Frequency [MHz]	FreqRange [MHz]	Result [dBm]	Limit [dBm]	Verdict
11A	Ant1	Low	5745	5720~5725	-45.7	≤16.34	PASS
11A	Ant1	Low	5745	5700~5720	-45.93	≤10.57	PASS
11A	Ant1	Low	5745	5650~5700	-47.47	≤-26.79	PASS
11A	Ant1	Low	5745	5760~5650	-47.21	≤-27	PASS
11A	Ant2	Low	5745	5720~5725	-46.45	≤16.34	PASS
11A	Ant2	Low	5745	5700~5720	-46.24	≤10.38	PASS
11A	Ant2	Low	5745	5650~5700	-46.58	≤-26.96	PASS
11A	Ant2	Low	5745	5760~5650	-46.66	≤-27	PASS
11A	Ant1	High	5825	5850~5855	-47.57	≤15.73	PASS
11A	Ant1	High	5825	5855~5875	-45.86	≤10.55	PASS
11A	Ant1	High	5825	5875~5925	-47.4	≤-26.91	PASS
11A	Ant1	High	5825	5925~5935	-45.67	≤-27	PASS
11A	Ant2	High	5825	5850~5855	-46.61	≤16.34	PASS
11A	Ant2	High	5825	5855~5875	-46.8	≤10.10	PASS
11A	Ant2	High	5825	5875~5925	-45.75	≤-26.81	PASS
11A	Ant2	High	5825	5925~5935	-46.01	≤-27	PASS
11N20SISO	Ant1	Low	5745	5720~5725	-44.07	≤16.08	PASS
11N20SISO	Ant1	Low	5745	5700~5720	-46.56	≤10.25	PASS
11N20SISO	Ant1	Low	5745	5650~5700	-47.71	≤-26.62	PASS
11N20SISO	Ant1	Low	5745	5760~5650	-46.71	≤-27	PASS
11N20SISO	Ant2	Low	5745	5720~5725	-43.77	≤16.34	PASS
11N20SISO	Ant2	Low	5745	5700~5720	-46.87	≤10.12	PASS
11N20SISO	Ant2	Low	5745	5650~5700	-47.13	≤-25.76	PASS
11N20SISO	Ant2	Low	5745	5760~5650	-46.8	≤-27	PASS
11N20SISO	Ant1	High	5825	5850~5855	-46.27	≤15.73	PASS
11N20SISO	Ant1	High	5825	5855~5875	-45.06	≤10.17	PASS
11N20SISO	Ant1	High	5825	5875~5925	-46.4	≤-26.11	PASS
11N20SISO	Ant1	High	5825	5925~5935	-45.77	≤-27	PASS
11N20SISO	Ant2	High	5825	5850~5855	-46.64	≤16.96	PASS
11N20SISO	Ant2	High	5825	5855~5875	-44.79	≤11.95	PASS
11N20SISO	Ant2	High	5825	5875~5925	-47	≤-25.61	PASS
11N20SISO	Ant2	High	5825	5925~5935	-46.32	≤-27	PASS
11N40SISO	Ant1	Low	5755	5720~5725	-45.5	≤16.04	PASS
11N40SISO	Ant1	Low	5755	5700~5720	-44.23	≤11.84	PASS
11N40SISO	Ant1	Low	5755	5650~5700	-46.66	≤-26.40	PASS
11N40SISO	Ant1	Low	5755	5780~5650	-46	≤-27	PASS
11N40SISO	Ant2	Low	5755	5720~5725	-46.38	≤15.74	PASS
11N40SISO	Ant2	Low	5755	5700~5720	-46.81	≤10.06	PASS
11N40SISO	Ant2	Low	5755	5650~5700	-46.55	≤-26.70	PASS


11N40SISO	Ant2	Low	5755	5780~5650	-46.72	≤-27	PASS
11N40SISO	Ant1	High	5795	5850~5855	-46.61	≤16.41	PASS
11N40SISO	Ant1	High	5795	5855~5875	-45.78	≤10.29	PASS
11N40SISO	Ant1	High	5795	5875~5925	-45.9	≤-26.95	PASS
11N40SISO	Ant1	High	5795	5925~5935	-44.98	≤-27	PASS
11N40SISO	Ant2	High	5795	5850~5855	-46.63	≤15.66	PASS
11N40SISO	Ant2	High	5795	5855~5875	-46.27	≤10.02	PASS
11N40SISO	Ant2	High	5795	5875~5925	-45.77	≤-26.46	PASS
11N40SISO	Ant2	High	5795	5925~5935	-45.8	≤-27	PASS
11AC20SISO	Ant1	Low	5745	5720~5725	-44.85	≤17.91	PASS
11AC20SISO	Ant1	Low	5745	5700~5720	-46.3	≤10.02	PASS
11AC20SISO	Ant1	Low	5745	5650~5700	-46.87	≤-26.62	PASS
11AC20SISO	Ant1	Low	5745	5760~5650	-45.66	≤-27	PASS
11AC20SISO	Ant2	Low	5745	5720~5725	-46.44	≤16.34	PASS
11AC20SISO	Ant2	Low	5745	5700~5720	-45.86	≤10.28	PASS
11AC20SISO	Ant2	Low	5745	5650~5700	-47.23	≤-26.79	PASS
11AC20SISO	Ant2	Low	5745	5760~5650	-46.06	≤-27	PASS
11AC20SISO	Ant1	High	5825	5850~5855	-44.18	≤17.26	PASS
11AC20SISO	Ant1	High	5825	5855~5875	-45.74	≤10.36	PASS
11AC20SISO	Ant1	High	5825	5875~5925	-46.83	≤-26.21	PASS
11AC20SISO	Ant1	High	5825	5925~5935	-46	≤-27	PASS
11AC20SISO	Ant2	High	5825	5850~5855	-47.09	≤15.73	PASS
11AC20SISO	Ant2	High	5825	5855~5875	-45.74	≤10.32	PASS
11AC20SISO	Ant2	High	5825	5875~5925	-47.37	≤-26.71	PASS
11AC20SISO	Ant2	High	5825	5925~5935	-46.34	≤-27	PASS
11AC40SISO	Ant1	Low	5755	5720~5725	-45.47	≤15.74	PASS
11AC40SISO	Ant1	Low	5755	5700~5720	-45.59	≤11.12	PASS
11AC40SISO	Ant1	Low	5755	5650~5700	-46.99	≤-26.80	PASS
11AC40SISO	Ant1	Low	5755	5780~5650	-47.03	≤-27	PASS
11AC40SISO	Ant2	Low	5755	5720~5725	-46.14	≤16.04	PASS
11AC40SISO	Ant2	Low	5755	5700~5720	-46.65	≤10.29	PASS
11AC40SISO	Ant2	Low	5755	5650~5700	-45.86	≤-26.90	PASS
11AC40SISO	Ant2	Low	5755	5780~5650	-46.64	≤-27	PASS
11AC40SISO	Ant1	High	5795	5850~5855	-46.8	≤15.66	PASS
11AC40SISO	Ant1	High	5795	5855~5875	-46.46	≤10.25	PASS
11AC40SISO	Ant1	High	5795	5875~5925	-46.37	≤-26.34	PASS
11AC40SISO	Ant1	High	5795	5925~5935	-45.49	≤-27	PASS
11AC40SISO	Ant2	High	5795	5850~5855	-46.66	≤15.66	PASS
11AC40SISO	Ant2	High	5795	5855~5875	-45.3	≤11.03	PASS
11AC40SISO	Ant2	High	5795	5875~5925	-46.56	≤-26.71	PASS
11AC40SISO	Ant2	High	5795	5925~5935	-46.1	≤-27	PASS
11AC80SISO	Ant1	Low	5775	5720~5725	-40.63	≤16.00	PASS

11AC80SISO	Ant1	Low	5775	5700~5720	-40.73	≤12.96	PASS
11AC80SISO	Ant1	Low	5775	5650~5700	-47.04	≤-26.46	PASS
11AC80SISO	Ant1	Low	5775	5800~5650	-45.93	≤-27	PASS
11AC80SISO	Ant1	High	5775	5850~5855	-45.59	≤15.84	PASS
11AC80SISO	Ant1	High	5775	5855~5875	-46.31	≤10.09	PASS
11AC80SISO	Ant1	High	5775	5875~5925	-44.61	≤-26.05	PASS
11AC80SISO	Ant1	High	5775	5925~5935	-45.81	≤-27	PASS
11AC80SISO	Ant2	Low	5775	5720~5725	-42.6	≤15.65	PASS
11AC80SISO	Ant2	Low	5775	5700~5720	-45.04	≤10.01	PASS
11AC80SISO	Ant2	Low	5775	5650~5700	-46.66	≤-26.69	PASS
11AC80SISO	Ant2	Low	5775	5800~5650	-45.27	≤-27	PASS
11AC80SISO	Ant2	High	5775	5850~5855	-44.81	≤15.84	PASS
11AC80SISO	Ant2	High	5775	5855~5875	-45.93	≤10.14	PASS
11AC80SISO	Ant2	High	5775	5875~5925	-47.32	≤-26.87	PASS
11AC80SISO	Ant2	High	5775	5925~5935	-45.38	≤-27	PASS
11AX20SISO	Ant1	Low	5745	5720~5725	-40.95	≤16.34	PASS
11AX20SISO	Ant1	Low	5745	5700~5720	-45.64	≤10.47	PASS
11AX20SISO	Ant1	Low	5745	5650~5700	-46.27	≤-26.10	PASS
11AX20SISO	Ant1	Low	5745	5760~5650	-46.31	≤-27	PASS
11AX20SISO	Ant2	Low	5745	5720~5725	-41.05	≤16.34	PASS
11AX20SISO	Ant2	Low	5745	5700~5720	-43.97	≤12.12	PASS
11AX20SISO	Ant2	Low	5745	5650~5700	-46.72	≤-26.62	PASS
11AX20SISO	Ant2	Low	5745	5760~5650	-46.35	≤-27	PASS
11AX20SISO	Ant1	High	5825	5850~5855	-47.3	≤15.73	PASS
11AX20SISO	Ant1	High	5825	5855~5875	-45.27	≤11.23	PASS
11AX20SISO	Ant1	High	5825	5875~5925	-46.13	≤-26.41	PASS
11AX20SISO	Ant1	High	5825	5925~5935	-46.03	≤-27	PASS
11AX20SISO	Ant2	High	5825	5850~5855	-46.97	≤15.73	PASS
11AX20SISO	Ant2	High	5825	5855~5875	-46.42	≤10.17	PASS
11AX20SISO	Ant2	High	5825	5875~5925	-45.68	≤-26.41	PASS
11AX20SISO	Ant2	High	5825	5925~5935	-45.66	≤-27	PASS
11AX40SISO	Ant1	Low	5755	5720~5725	-45.89	≤16.35	PASS
11AX40SISO	Ant1	Low	5755	5700~5720	-46.45	≤10.36	PASS
11AX40SISO	Ant1	Low	5755	5650~5700	-46.48	≤-26.40	PASS
11AX40SISO	Ant1	Low	5755	5780~5650	-46.35	≤-27	PASS
11AX40SISO	Ant2	Low	5755	5720~5725	-44.57	≤17.28	PASS
11AX40SISO	Ant2	Low	5755	5700~5720	-45.66	≤10.67	PASS
11AX40SISO	Ant2	Low	5755	5650~5700	-47.19	≤-26.50	PASS
11AX40SISO	Ant2	Low	5755	5780~5650	-46.62	≤-27	PASS
11AX40SISO	Ant1	High	5795	5850~5855	-46.62	≤15.66	PASS
11AX40SISO	Ant1	High	5795	5855~5875	-44.28	≤10.57	PASS
11AX40SISO	Ant1	High	5795	5875~5925	-46.34	≤-26.71	PASS

11AX40SISO	Ant1	High	5795	5925~5935	-45.89	≤-27	PASS
11AX40SISO	Ant2	High	5795	5850~5855	-46.62	≤15.66	PASS
11AX40SISO	Ant2	High	5795	5855~5875	-45.31	≤10.20	PASS
11AX40SISO	Ant2	High	5795	5875~5925	-46.79	≤-26.22	PASS
11AX40SISO	Ant2	High	5795	5925~5935	-46.25	≤-27	PASS
11AX80SISO	Ant1	Low	5775	5720~5725	-44.6	≤16.00	PASS
11AX80SISO	Ant1	Low	5775	5700~5720	-43.57	≤11.40	PASS
11AX80SISO	Ant1	Low	5775	5650~5700	-46.58	≤-26.91	PASS
11AX80SISO	Ant1	Low	5775	5800~5650	-45.81	≤-27	PASS
11AX80SISO	Ant1	High	5775	5850~5855	-46.59	≤16.26	PASS
11AX80SISO	Ant1	High	5775	5855~5875	-45.27	≤10.50	PASS
11AX80SISO	Ant1	High	5775	5875~5925	-46.5	≤-26.87	PASS
11AX80SISO	Ant1	High	5775	5925~5935	-46.09	≤-27	PASS
11AX80SISO	Ant2	Low	5775	5720~5725	-44.45	≤15.65	PASS
11AX80SISO	Ant2	Low	5775	5700~5720	-45.24	≤10.14	PASS
11AX80SISO	Ant2	Low	5775	5650~5700	-46.44	≤-26.80	PASS
11AX80SISO	Ant2	Low	5775	5800~5650	-46.19	≤-27	PASS
11AX80SISO	Ant2	High	5775	5850~5855	-45.59	≤16.68	PASS
11AX80SISO	Ant2	High	5775	5855~5875	-45.22	≤10.71	PASS
11AX80SISO	Ant2	High	5775	5875~5925	-45.2	≤-26.05	PASS
11AX80SISO	Ant2	High	5775	5925~5935	-46.03	≤-27	PASS

Note: The margin plus the antenna gain also meets the limit.


Test Graphs B1/2/3

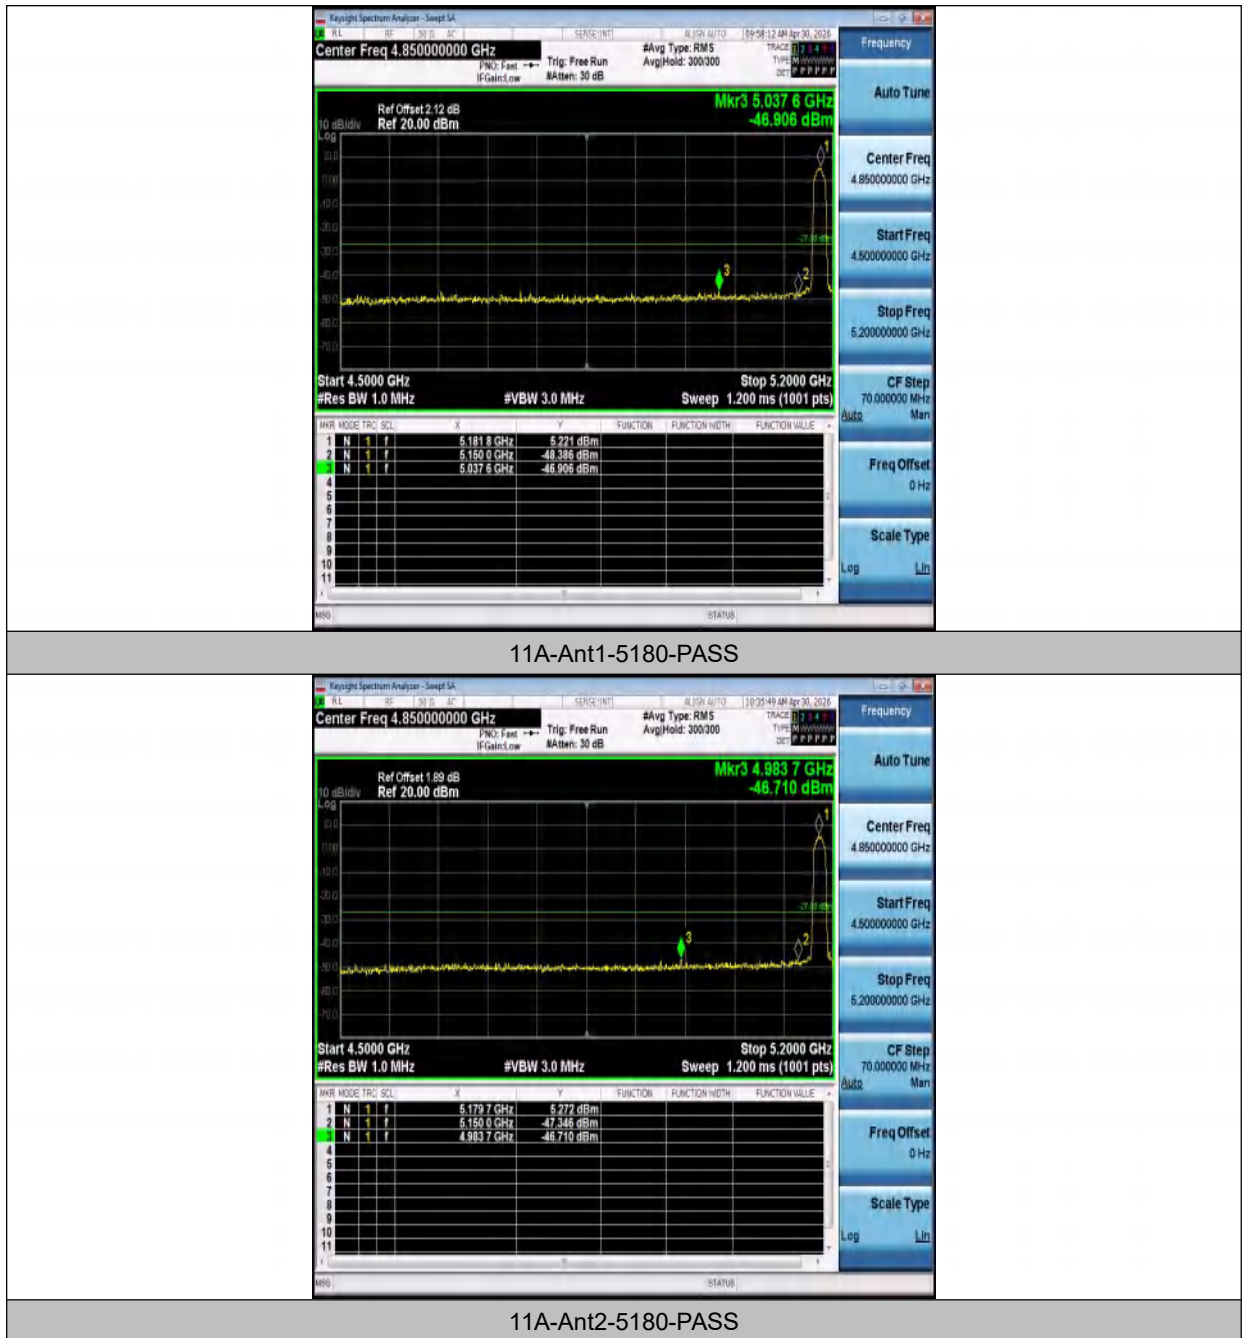


Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

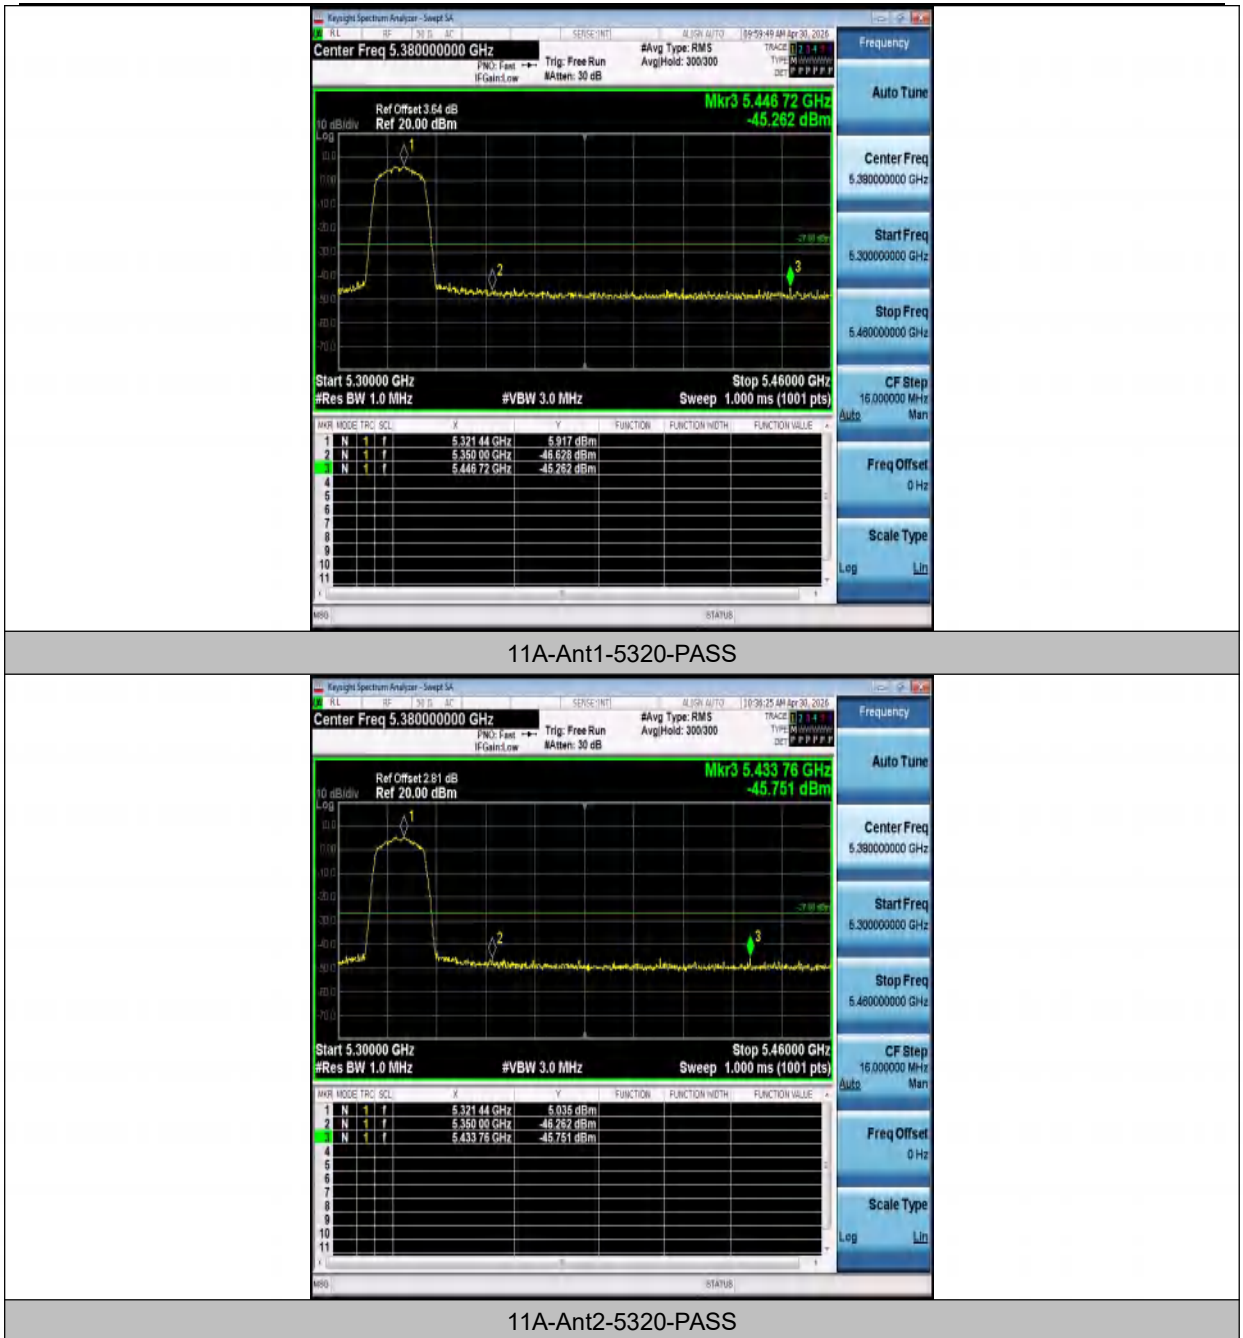

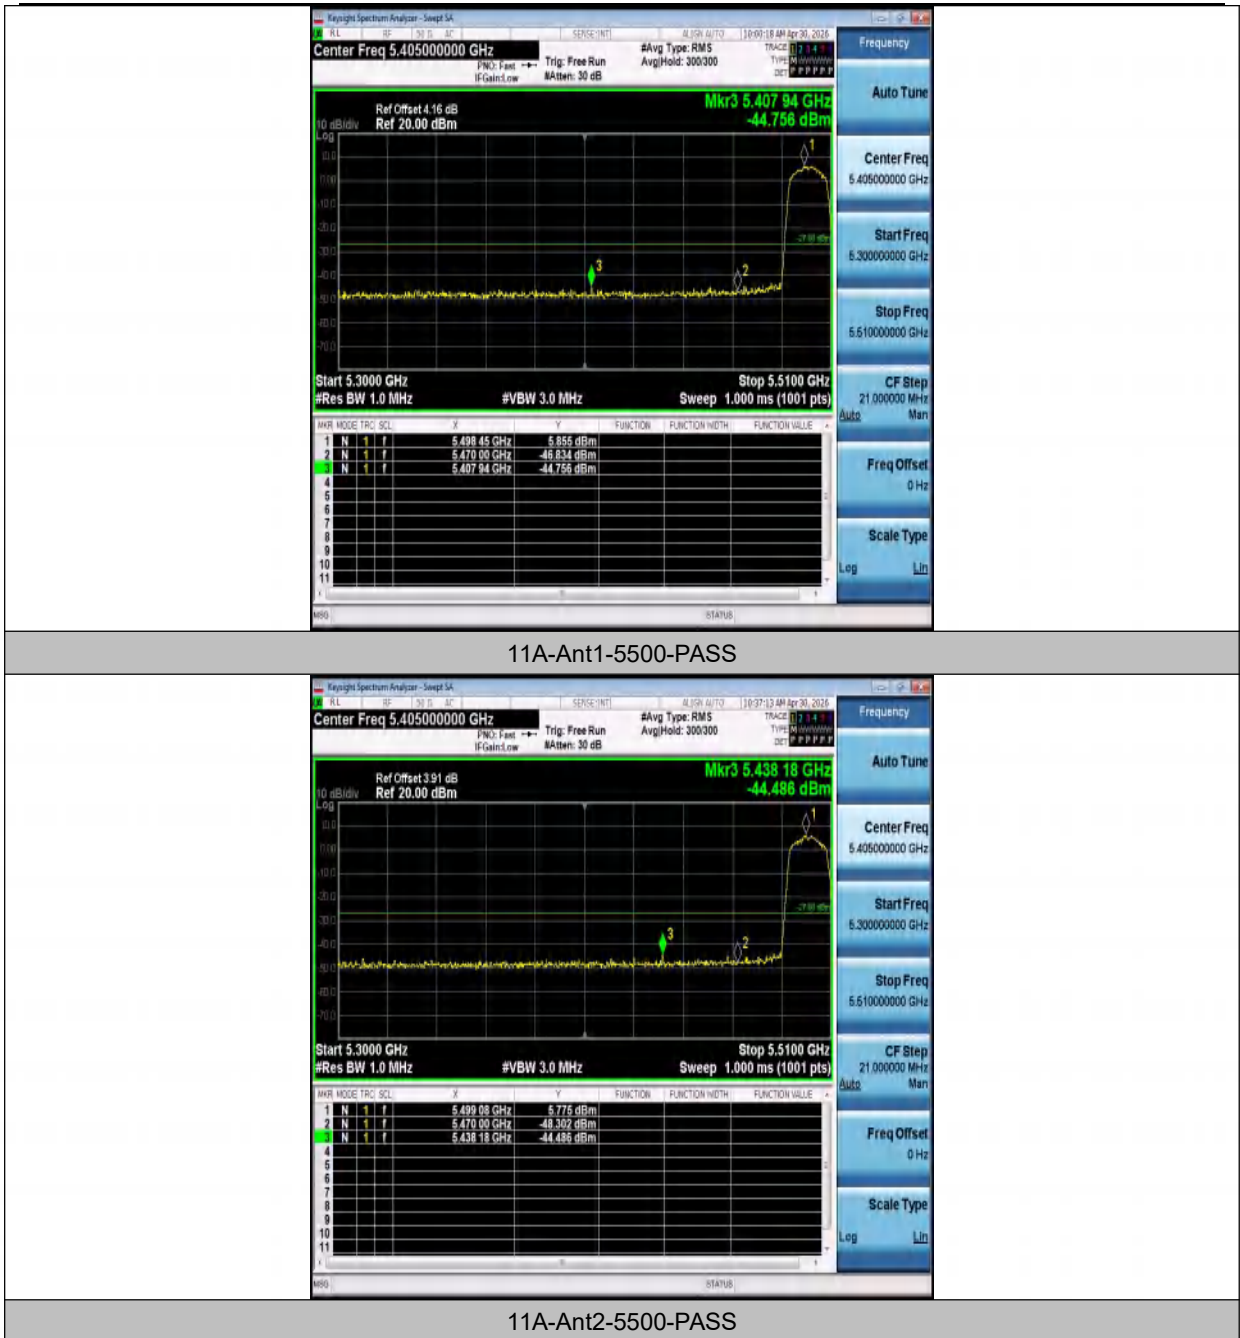




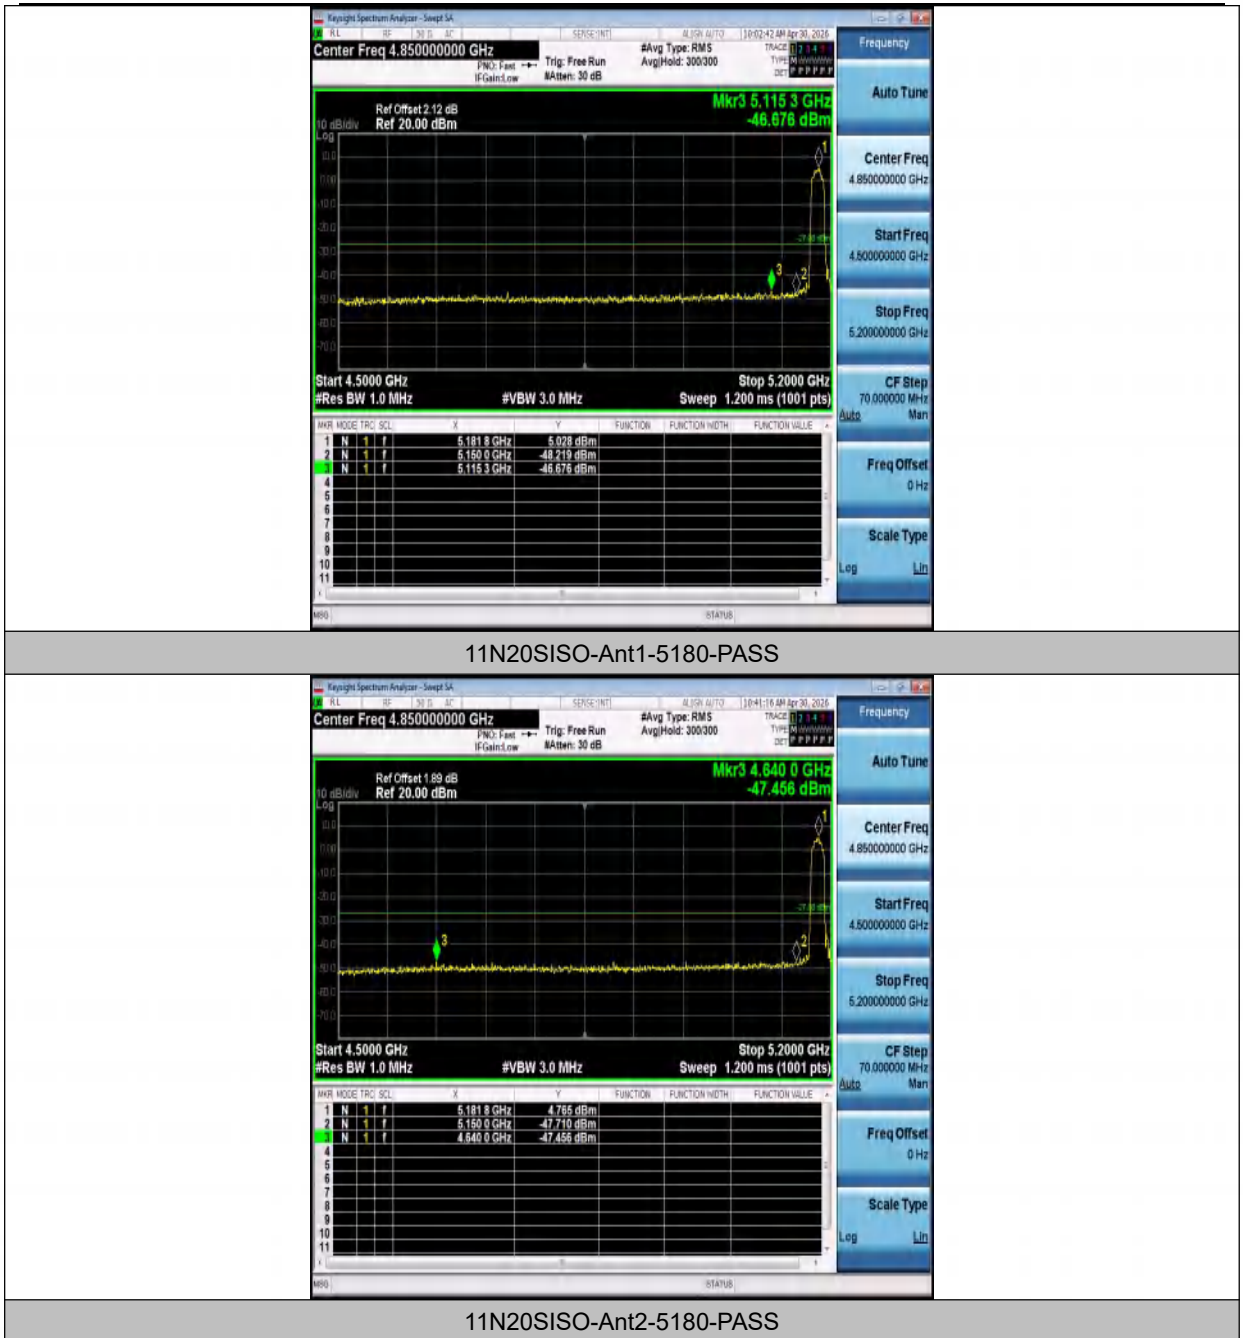

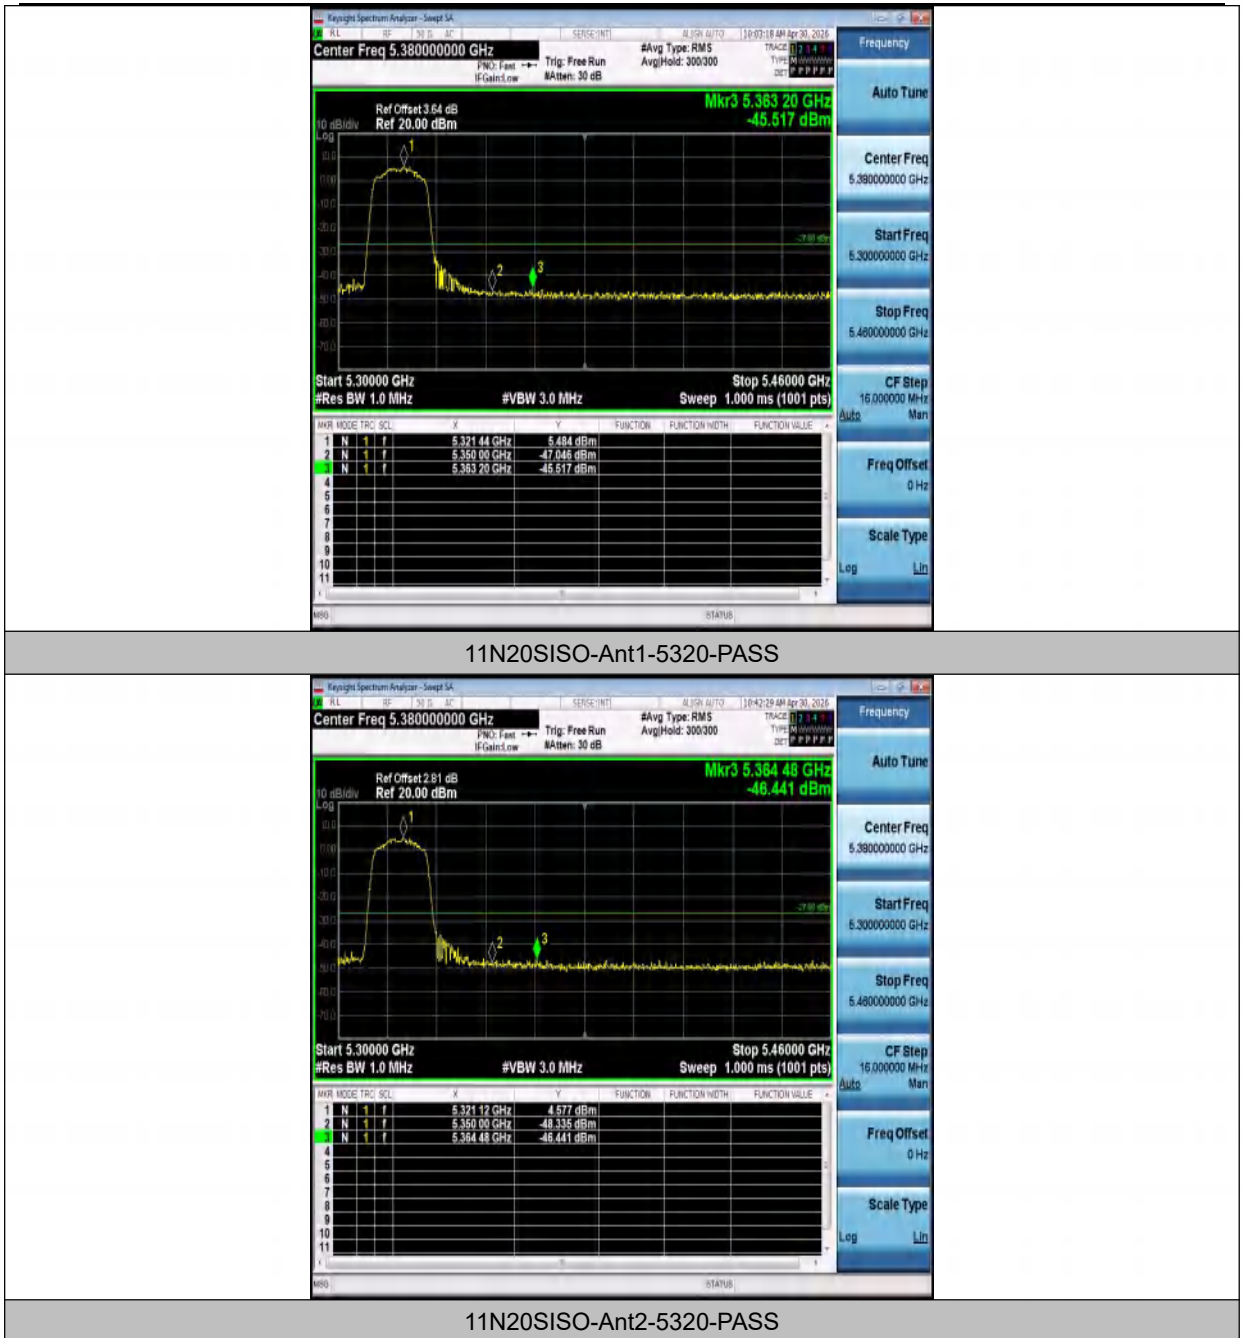




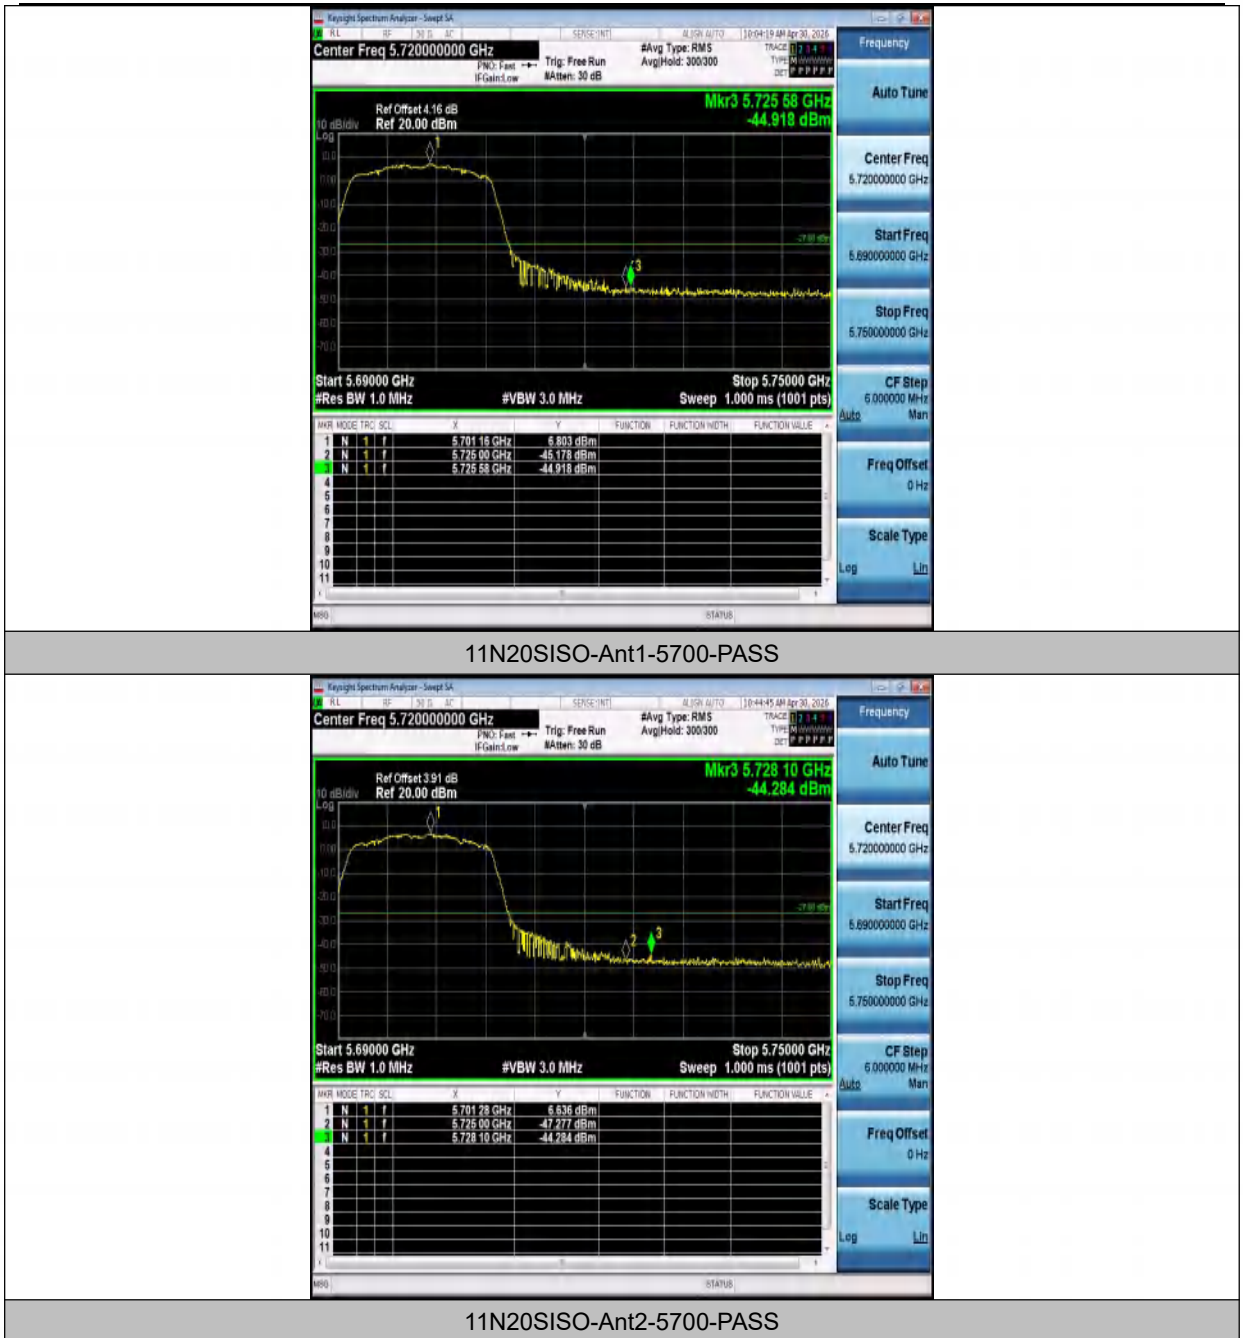

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

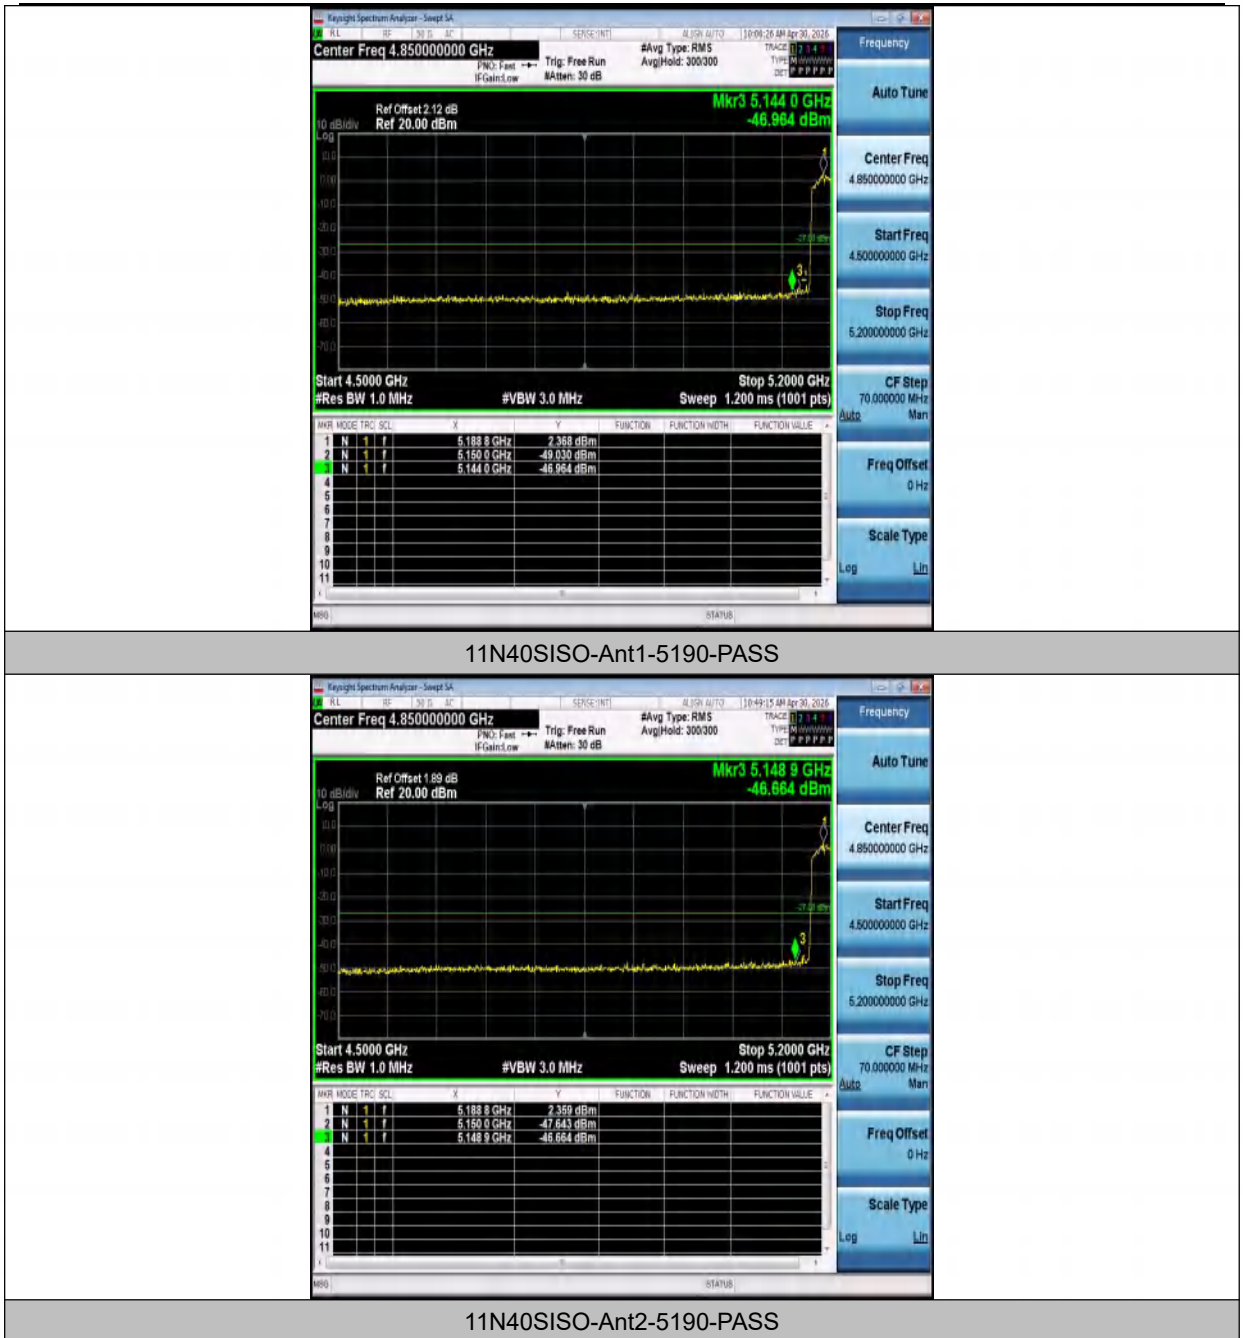



Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

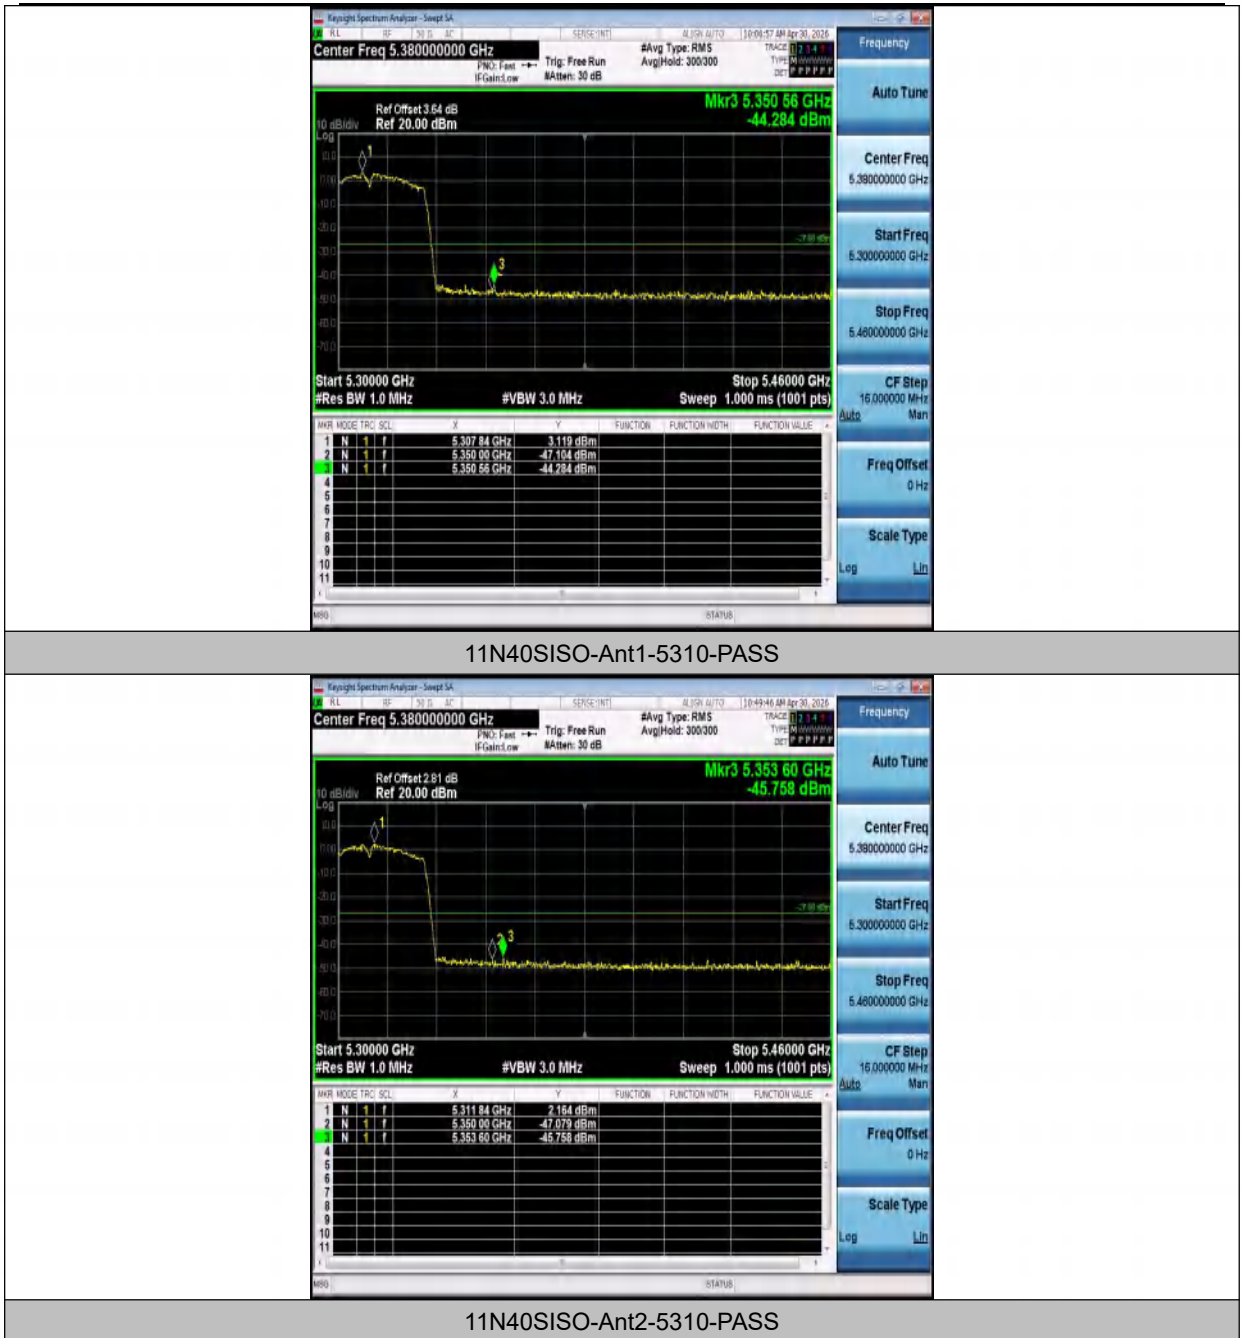


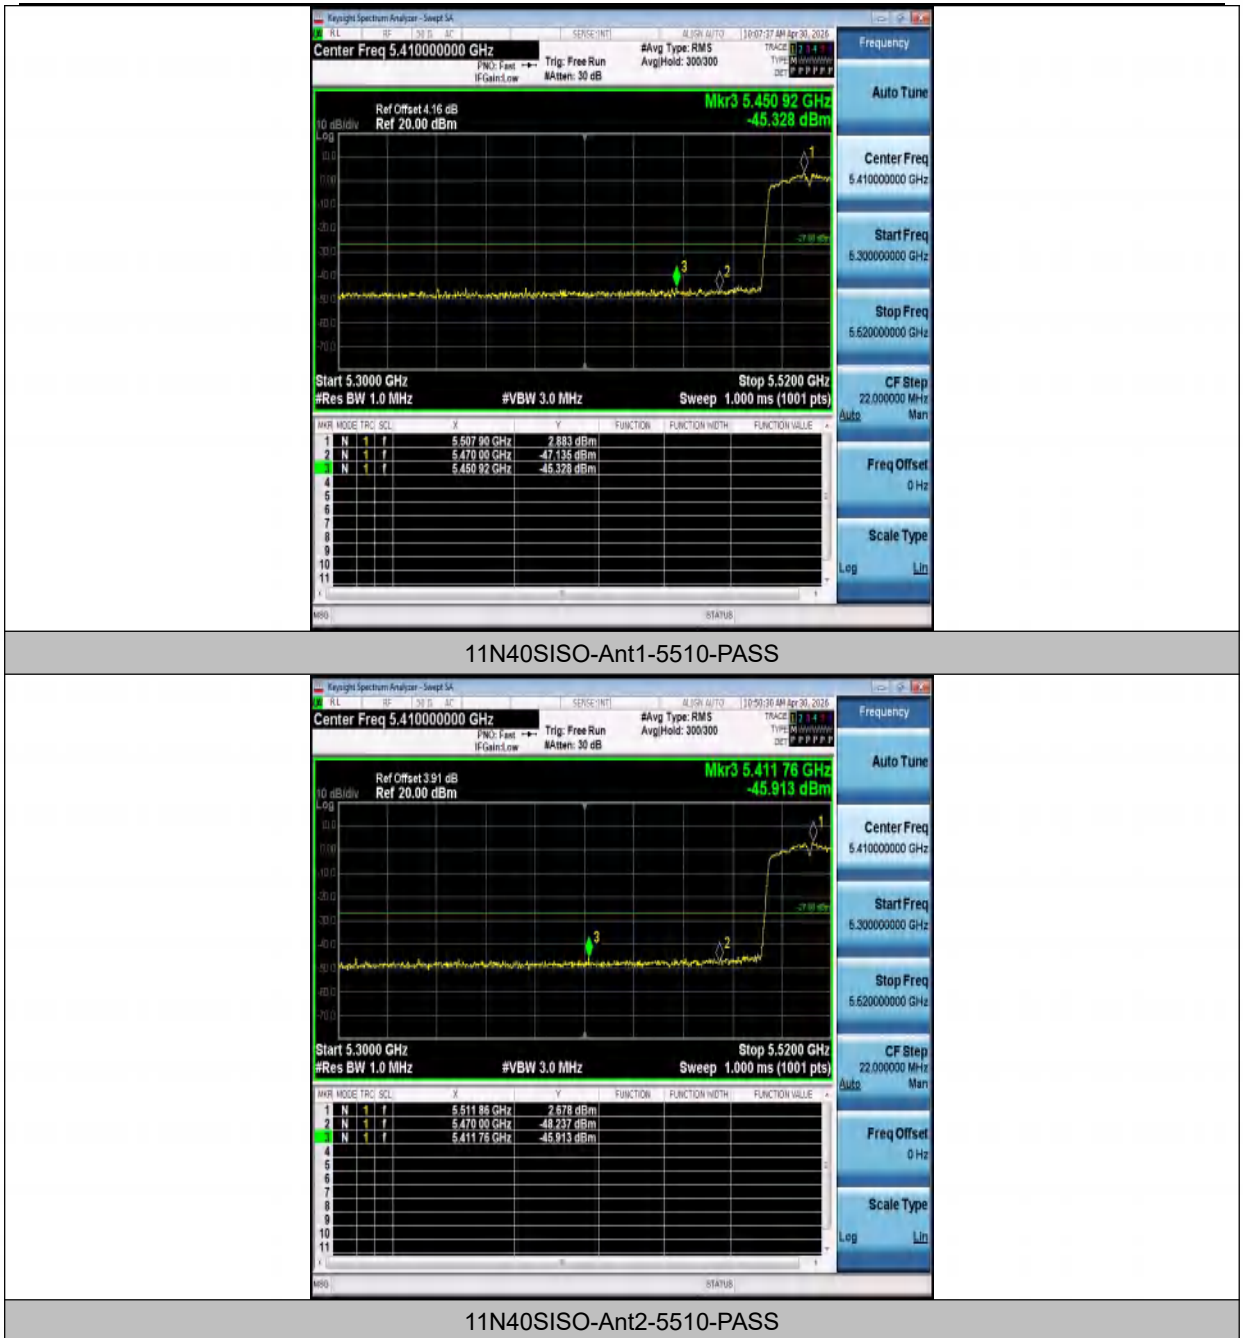

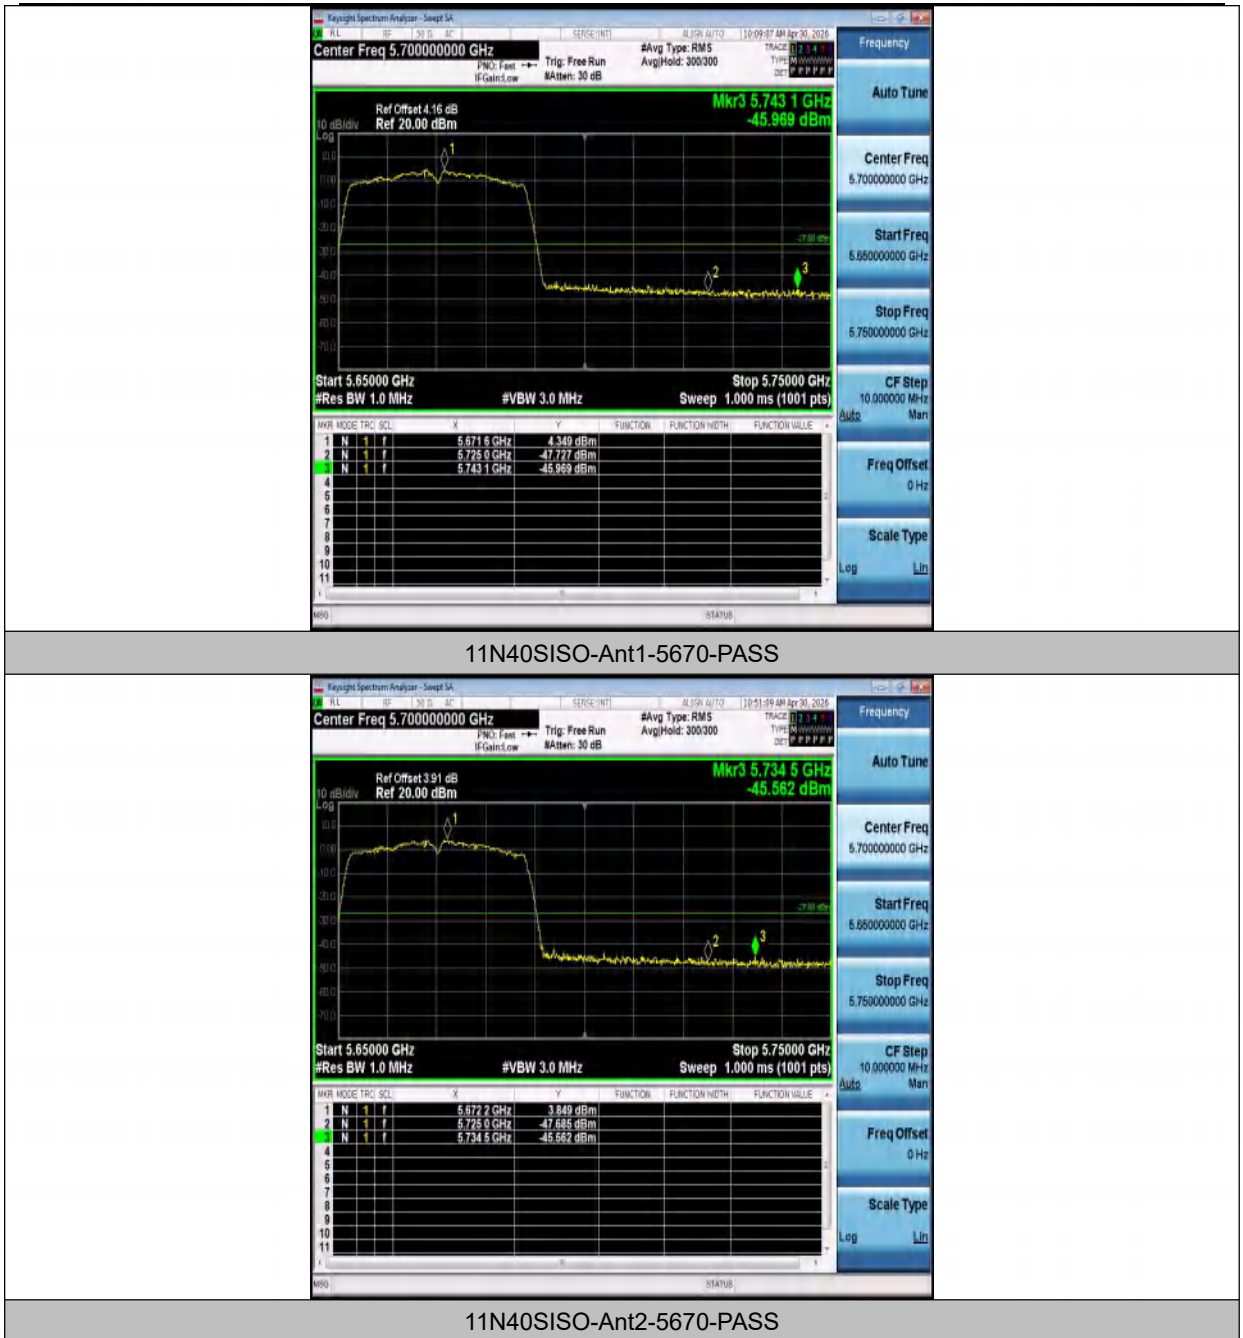


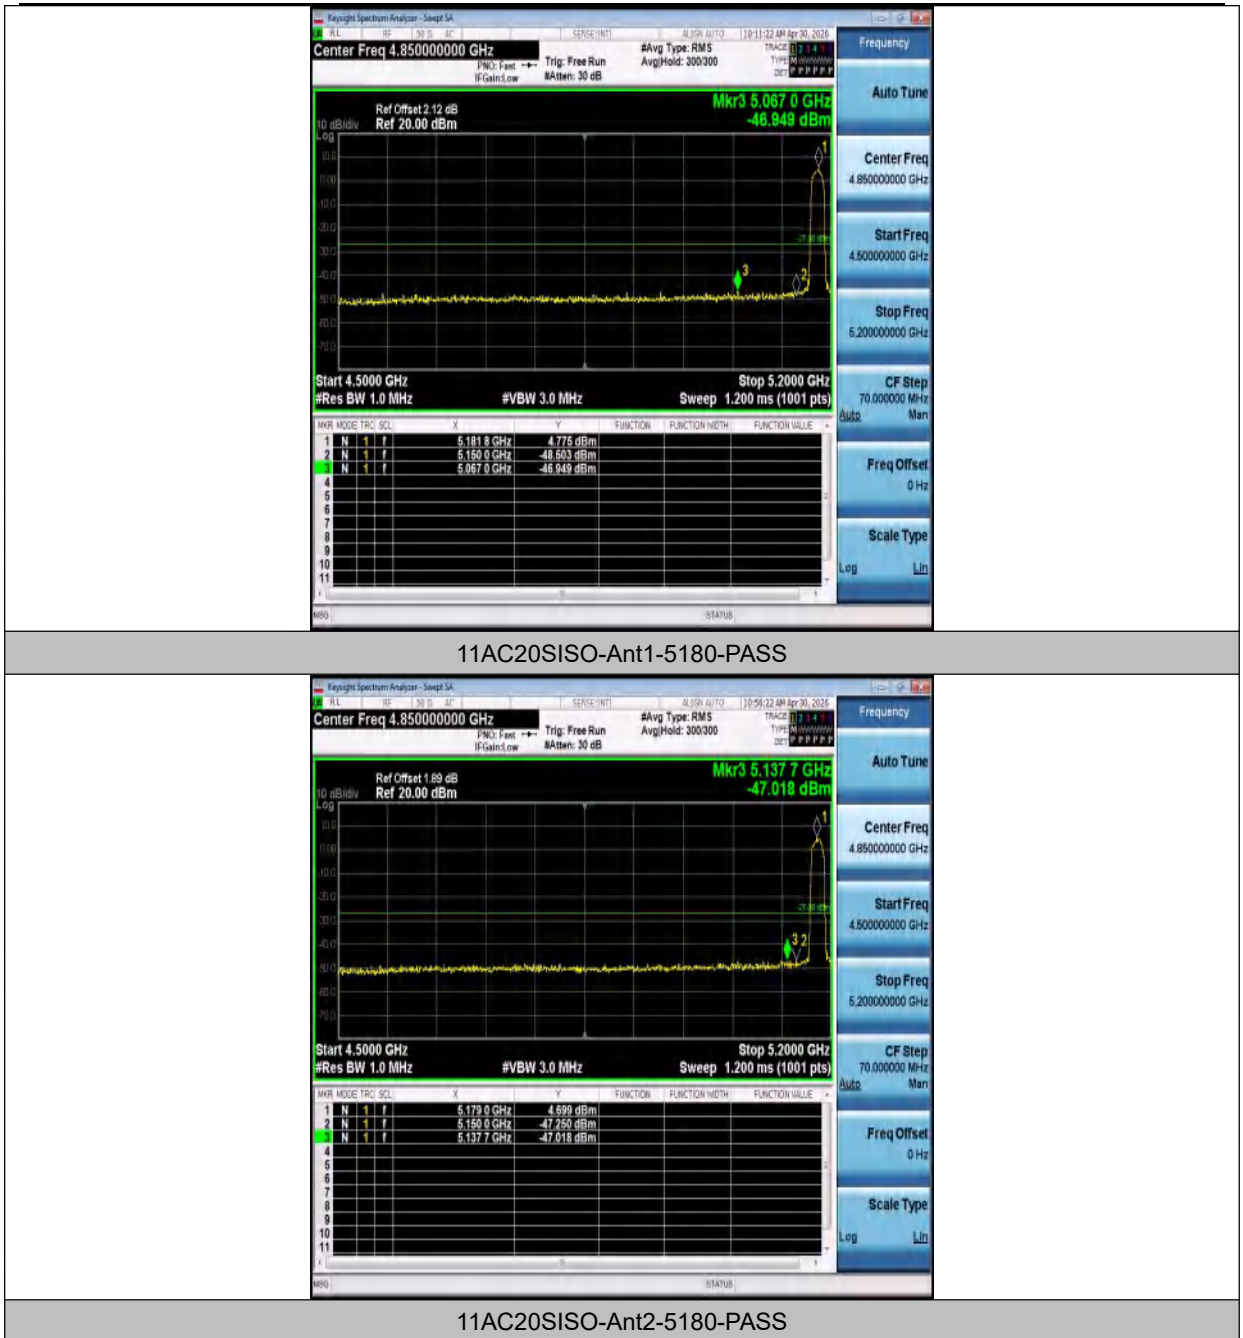


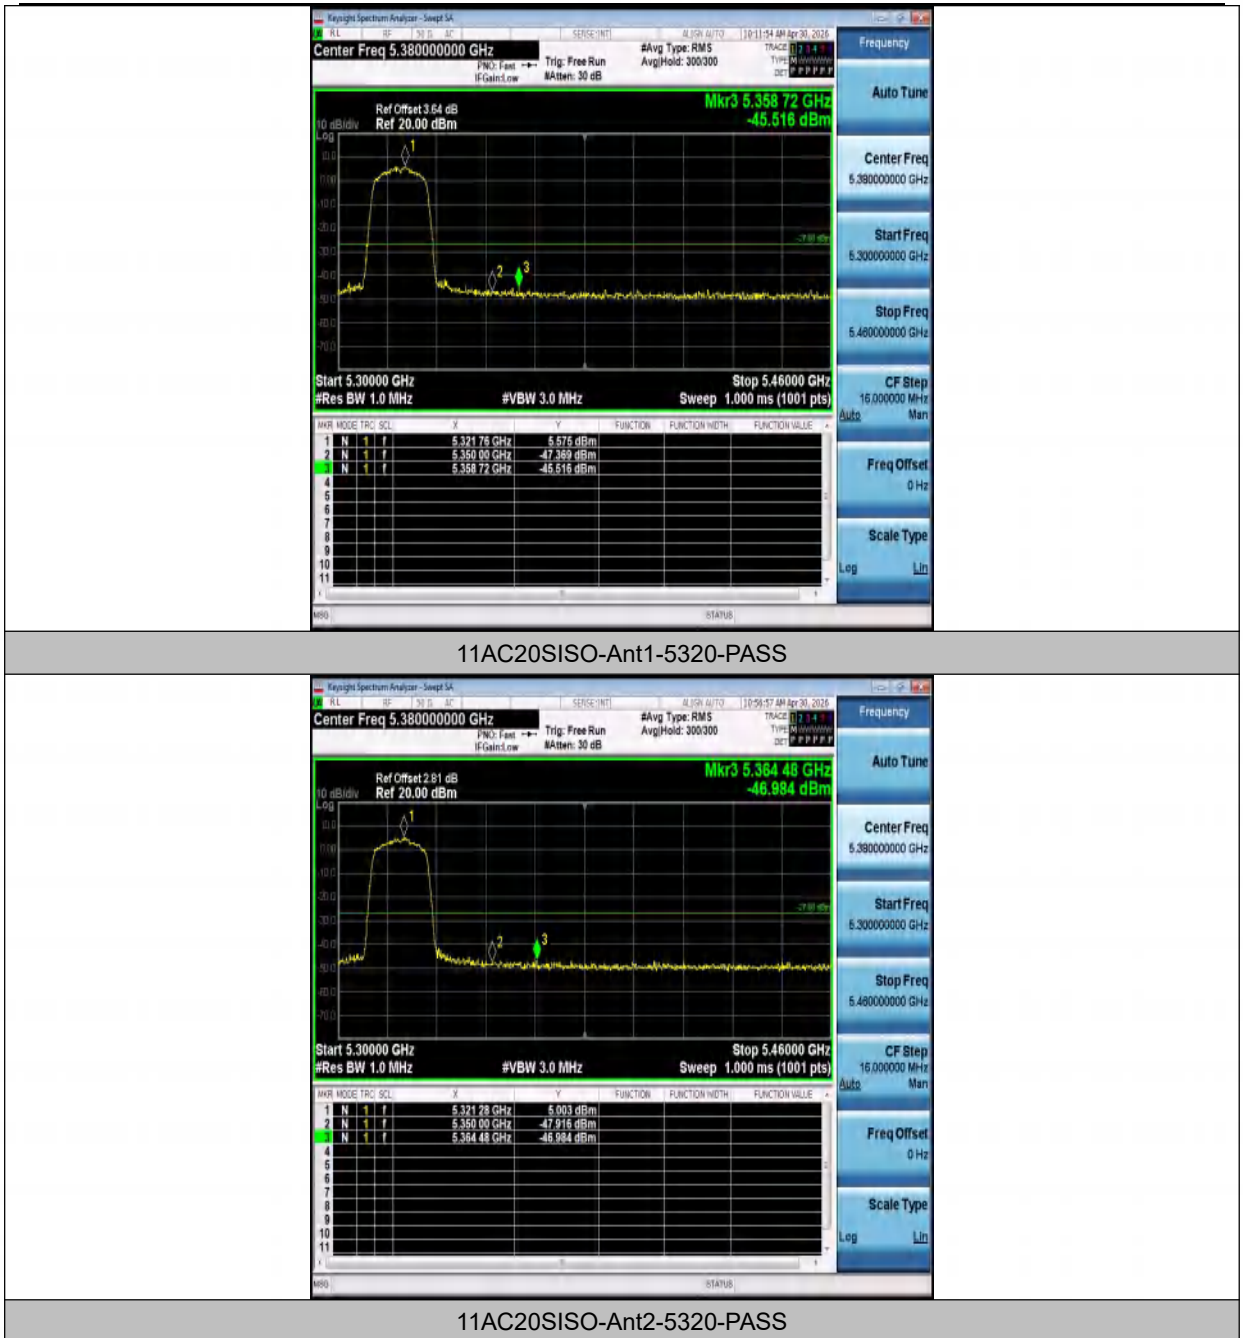


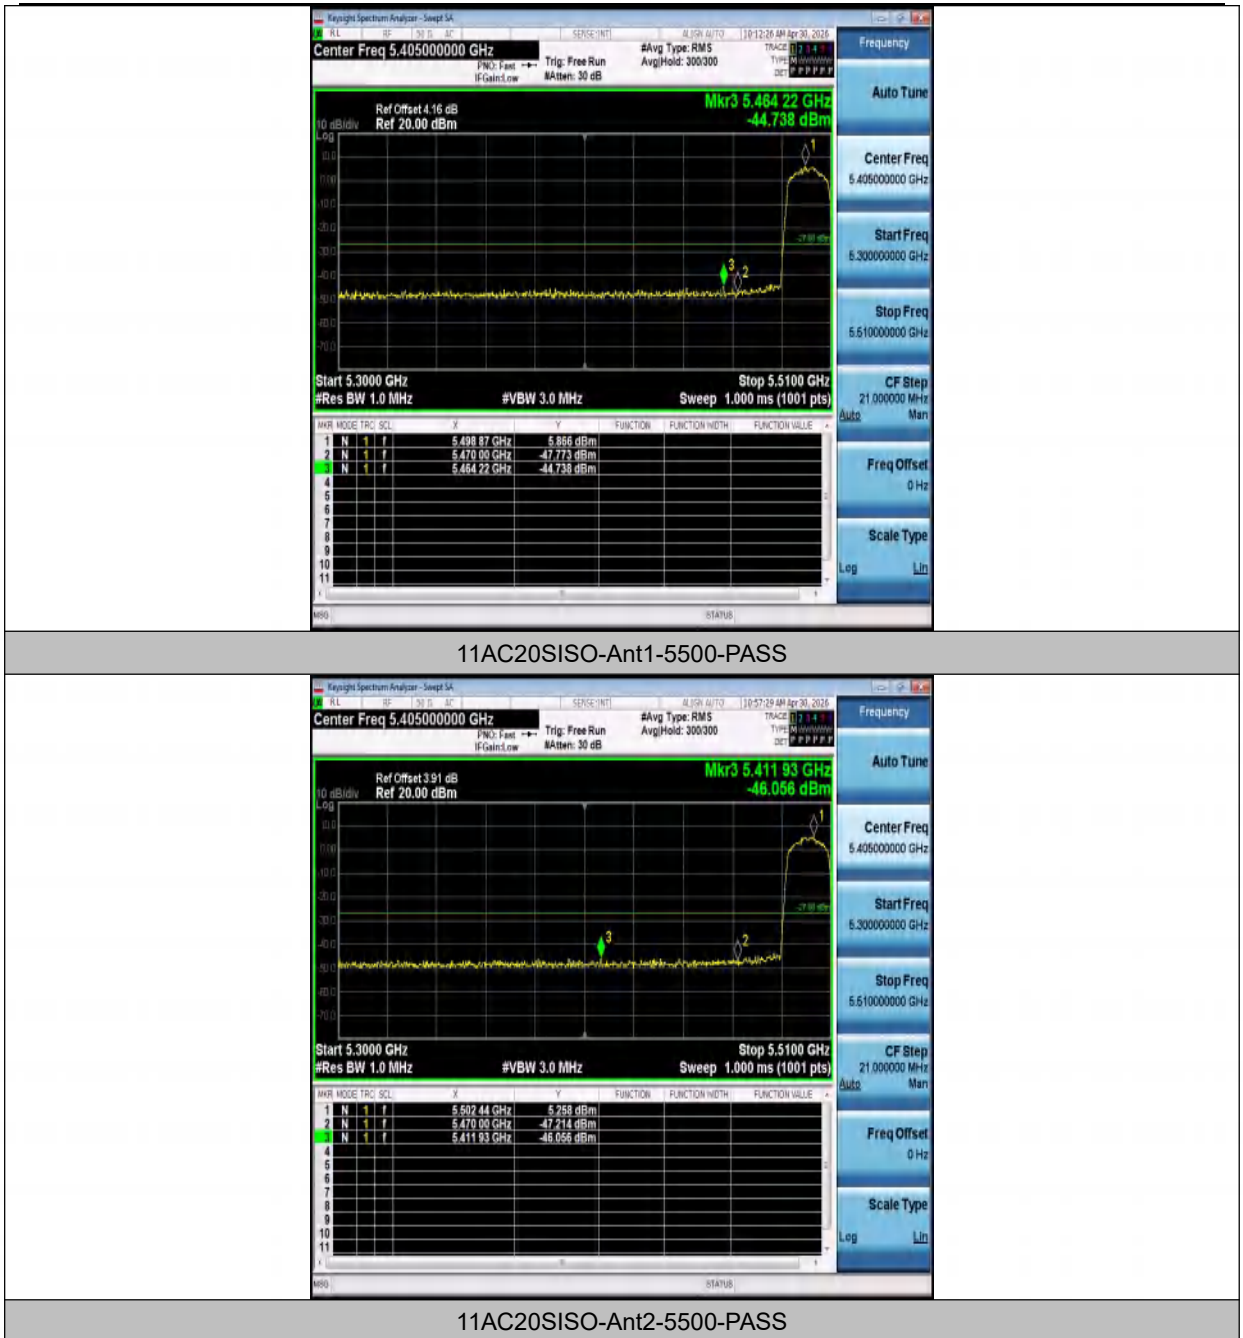





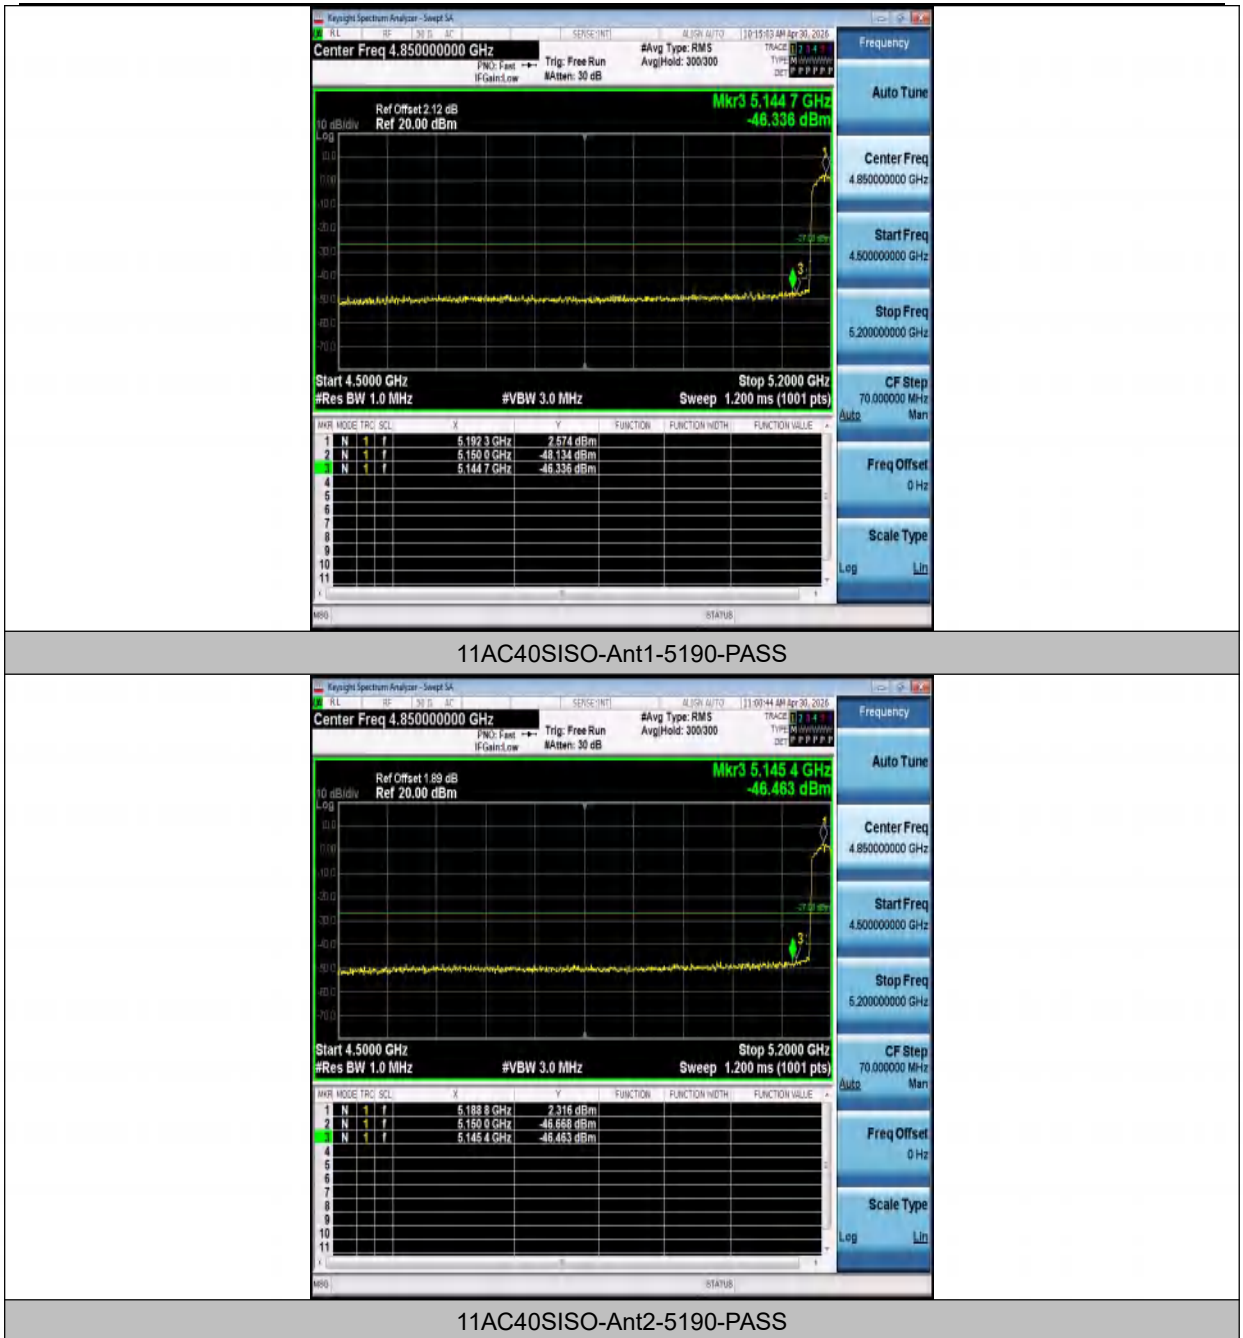


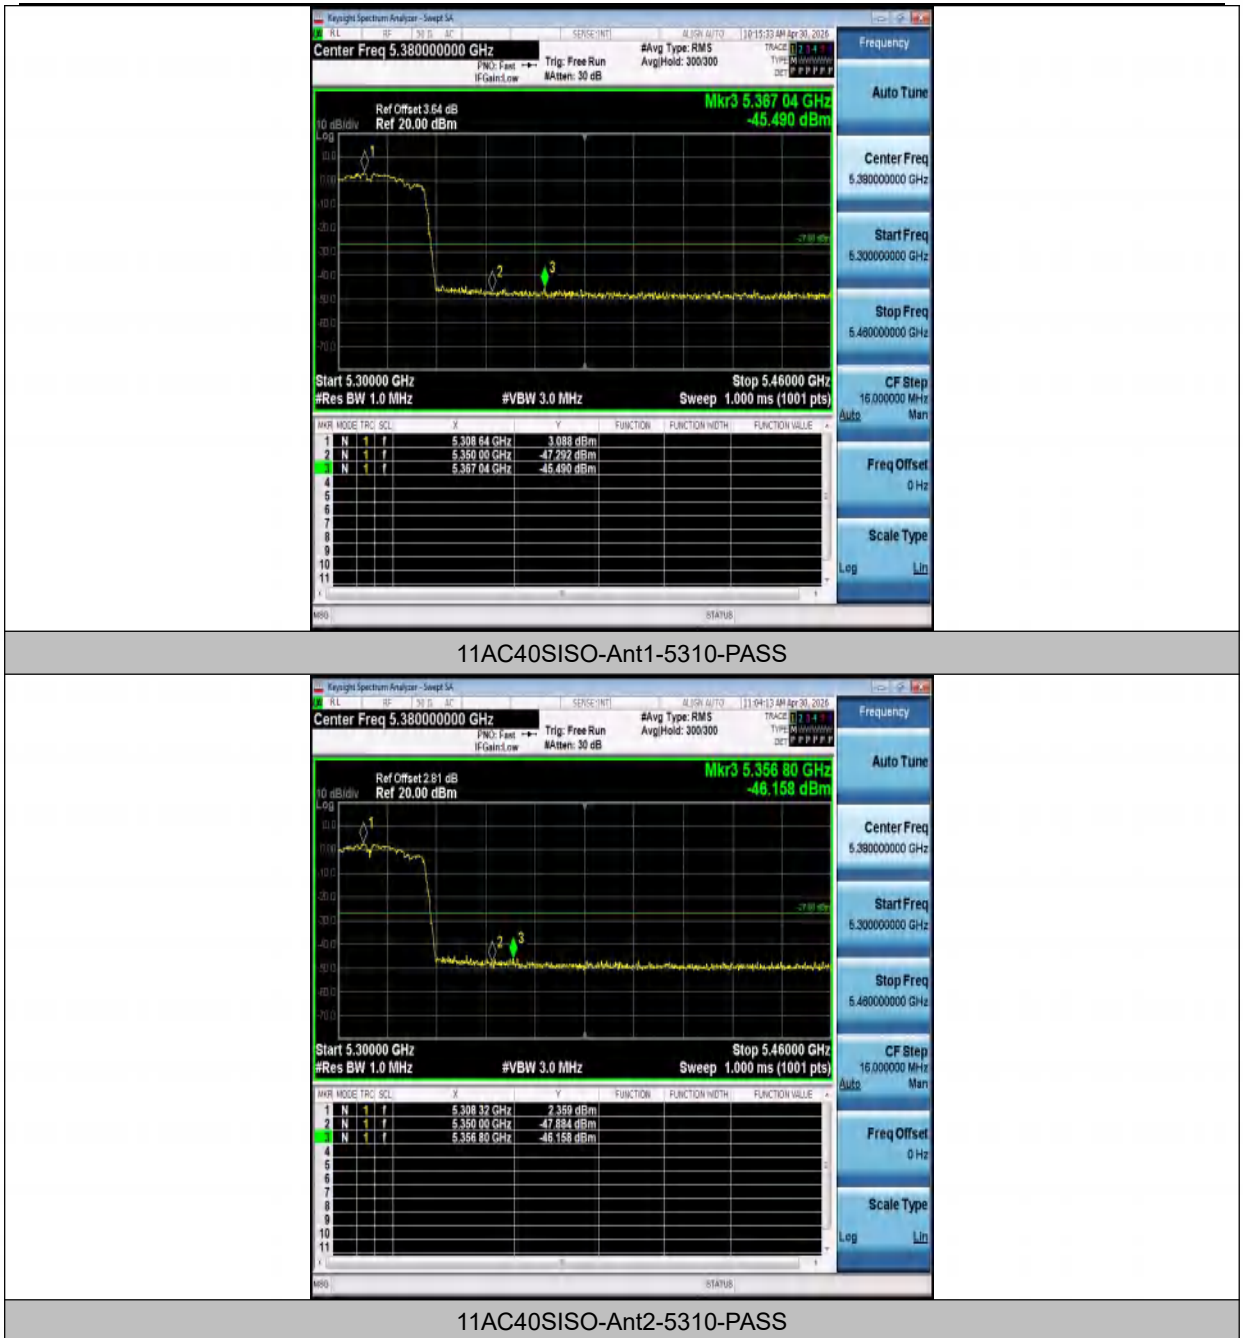

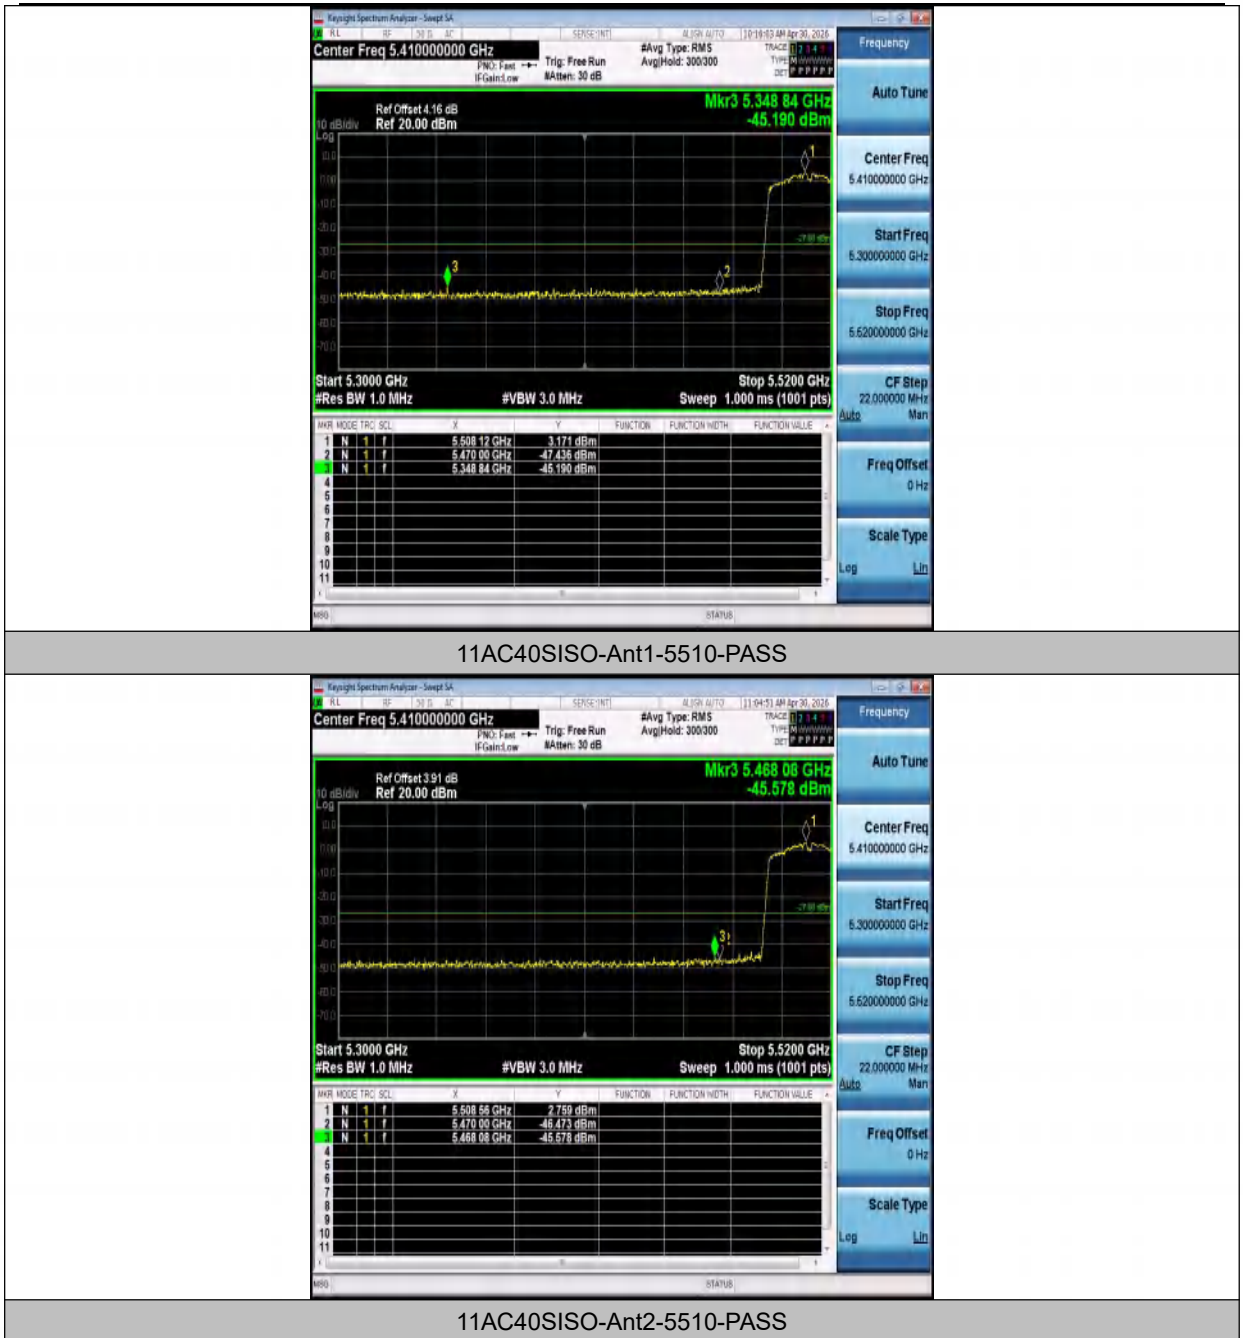

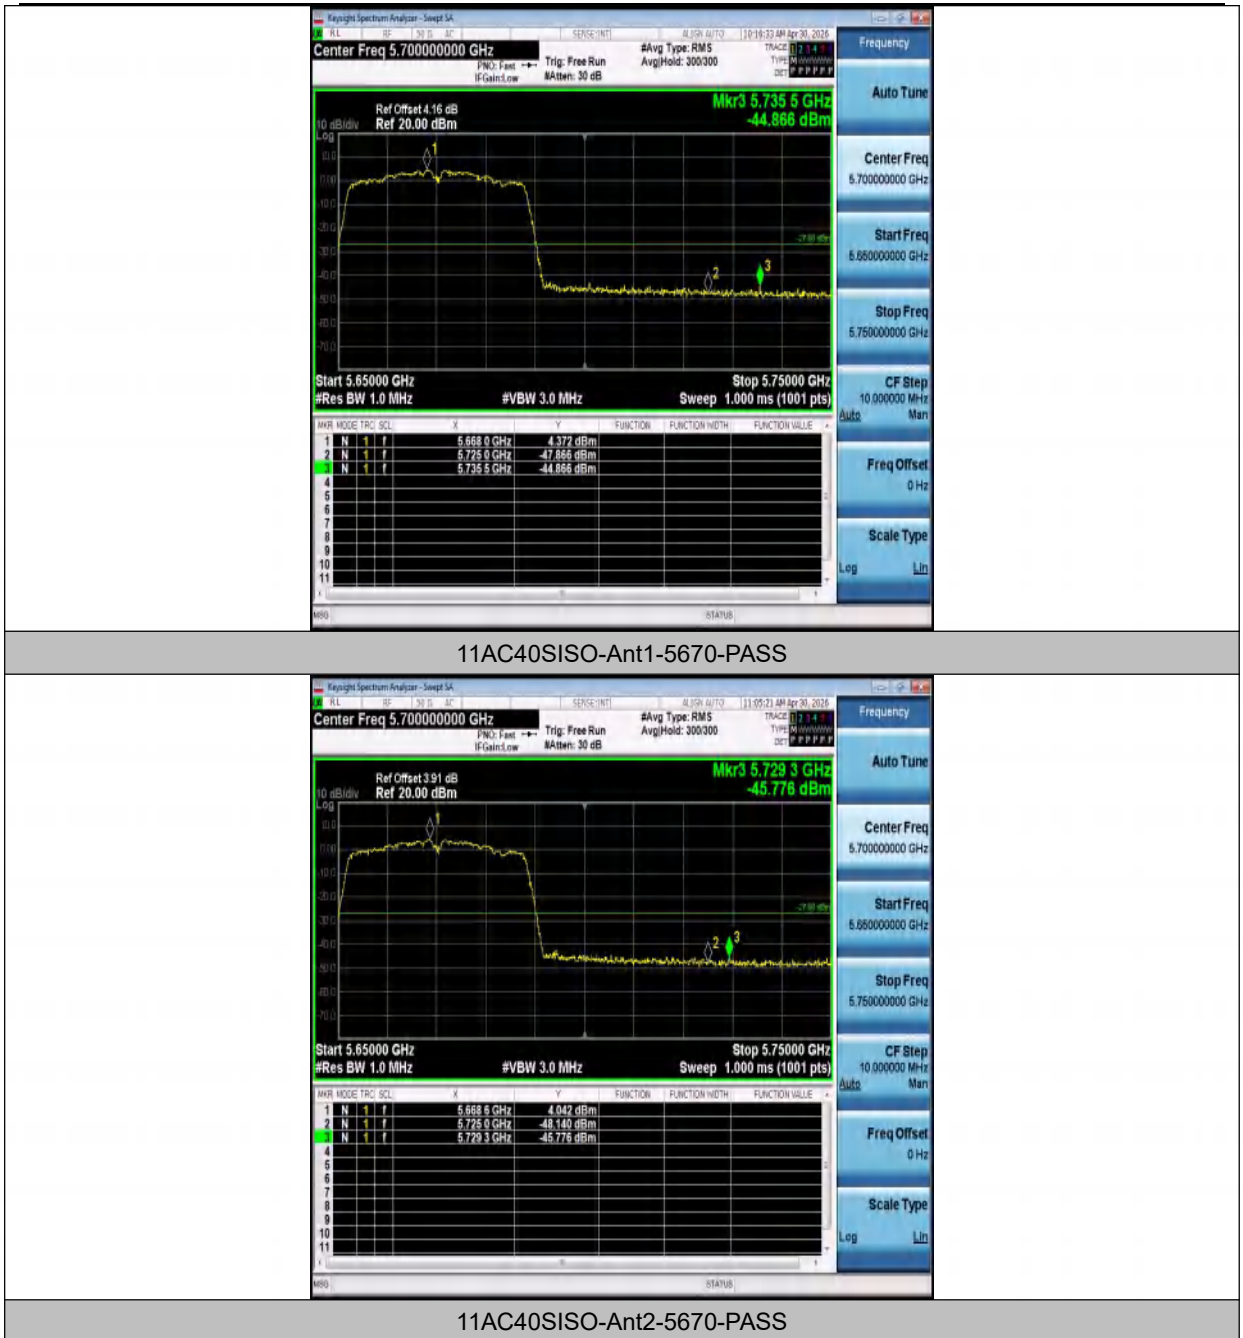

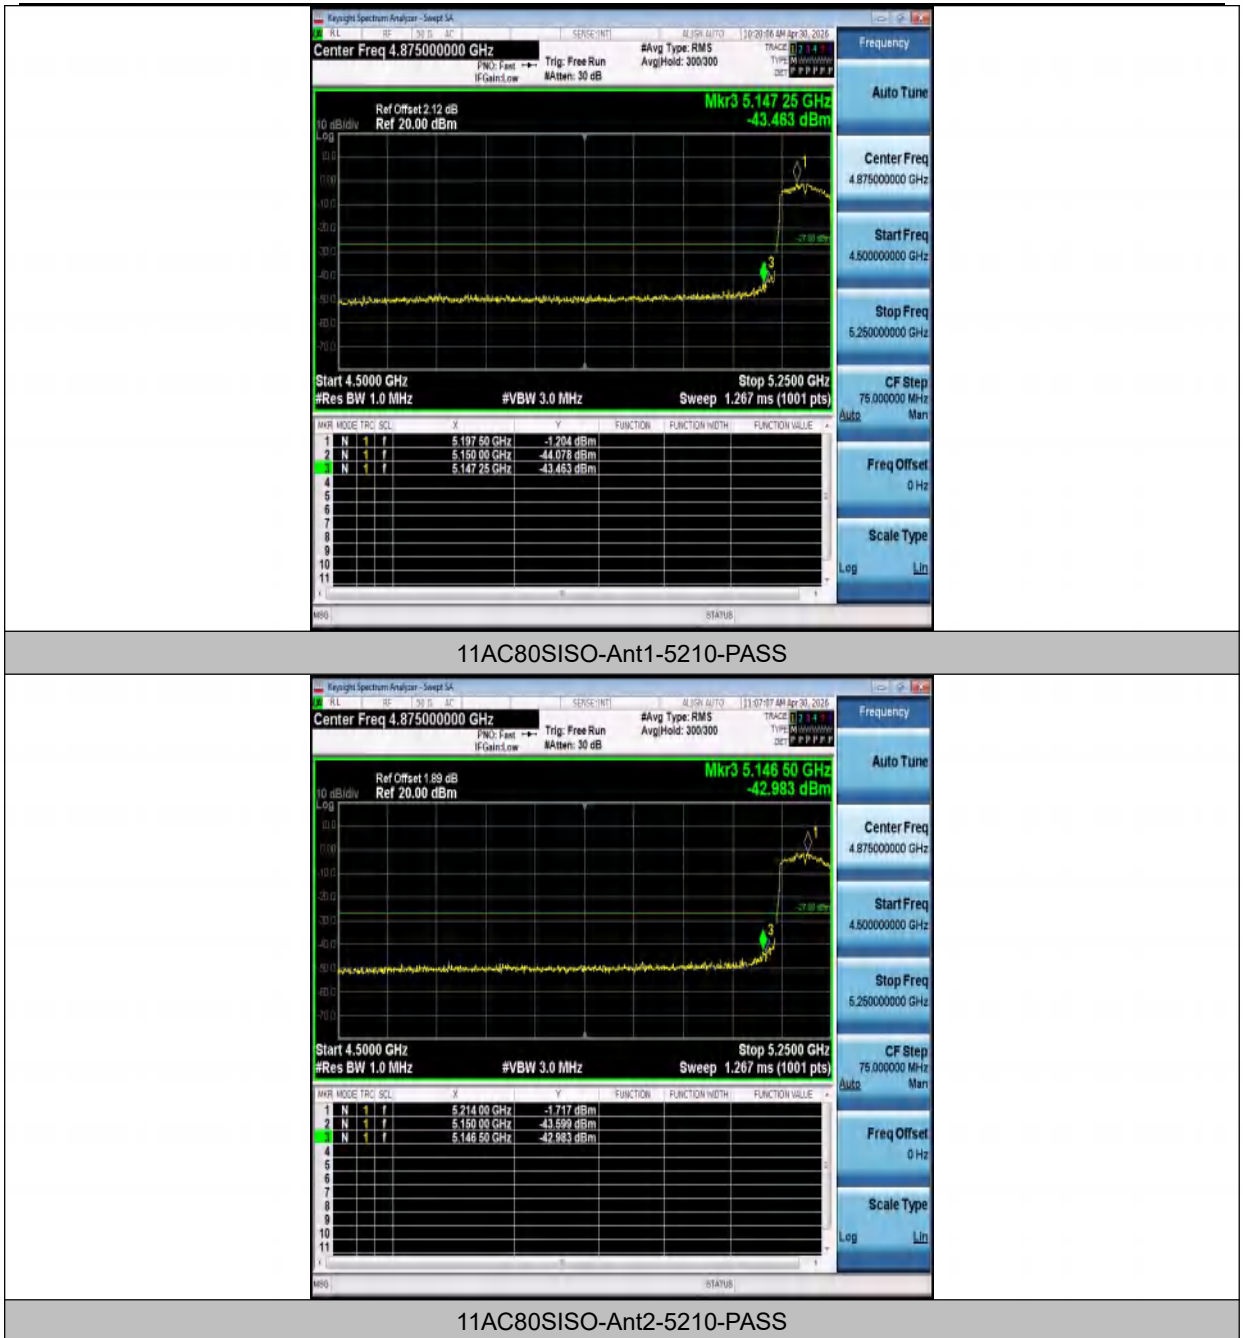

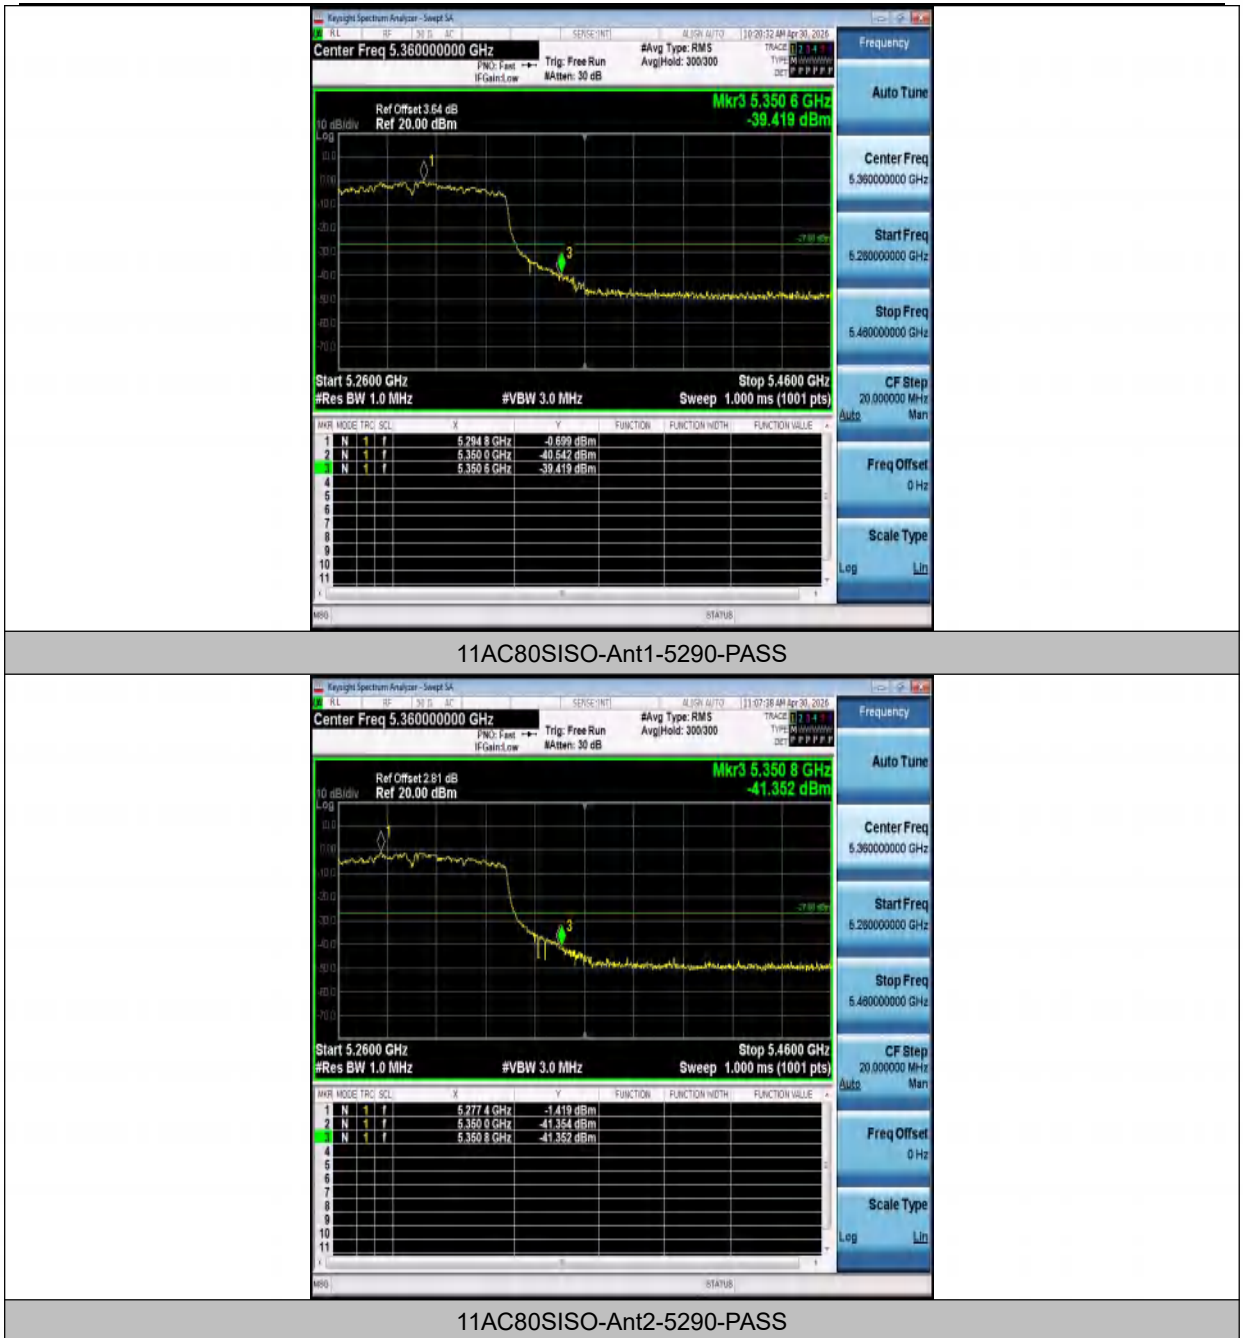



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



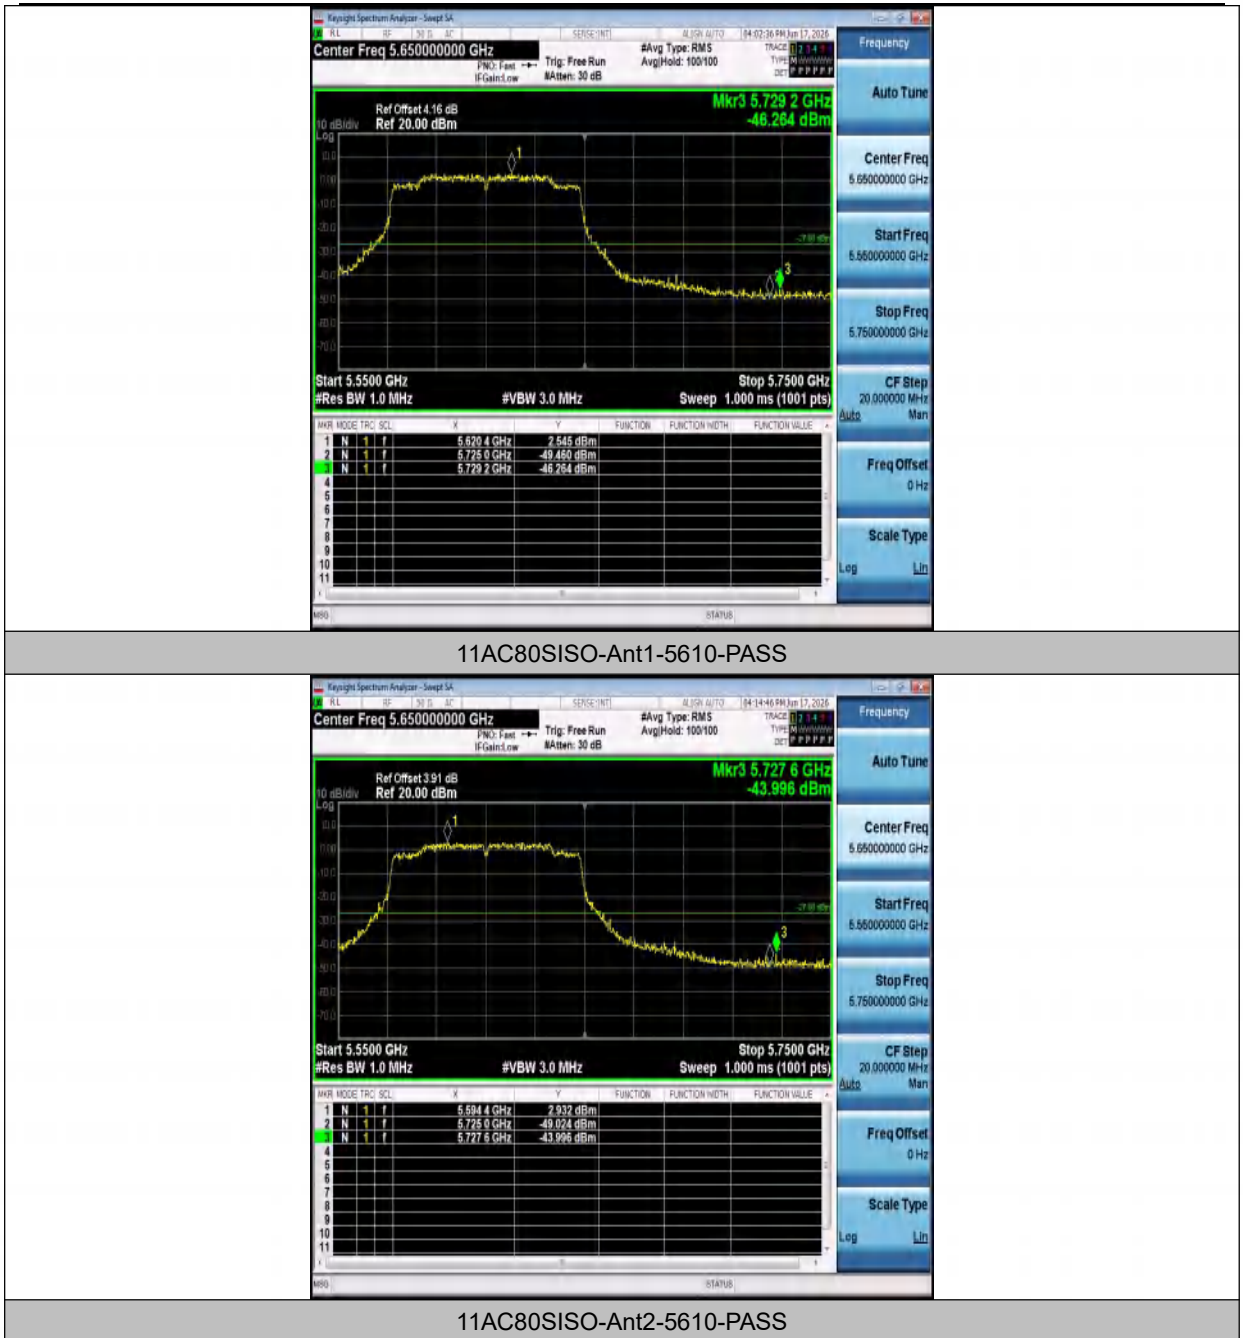

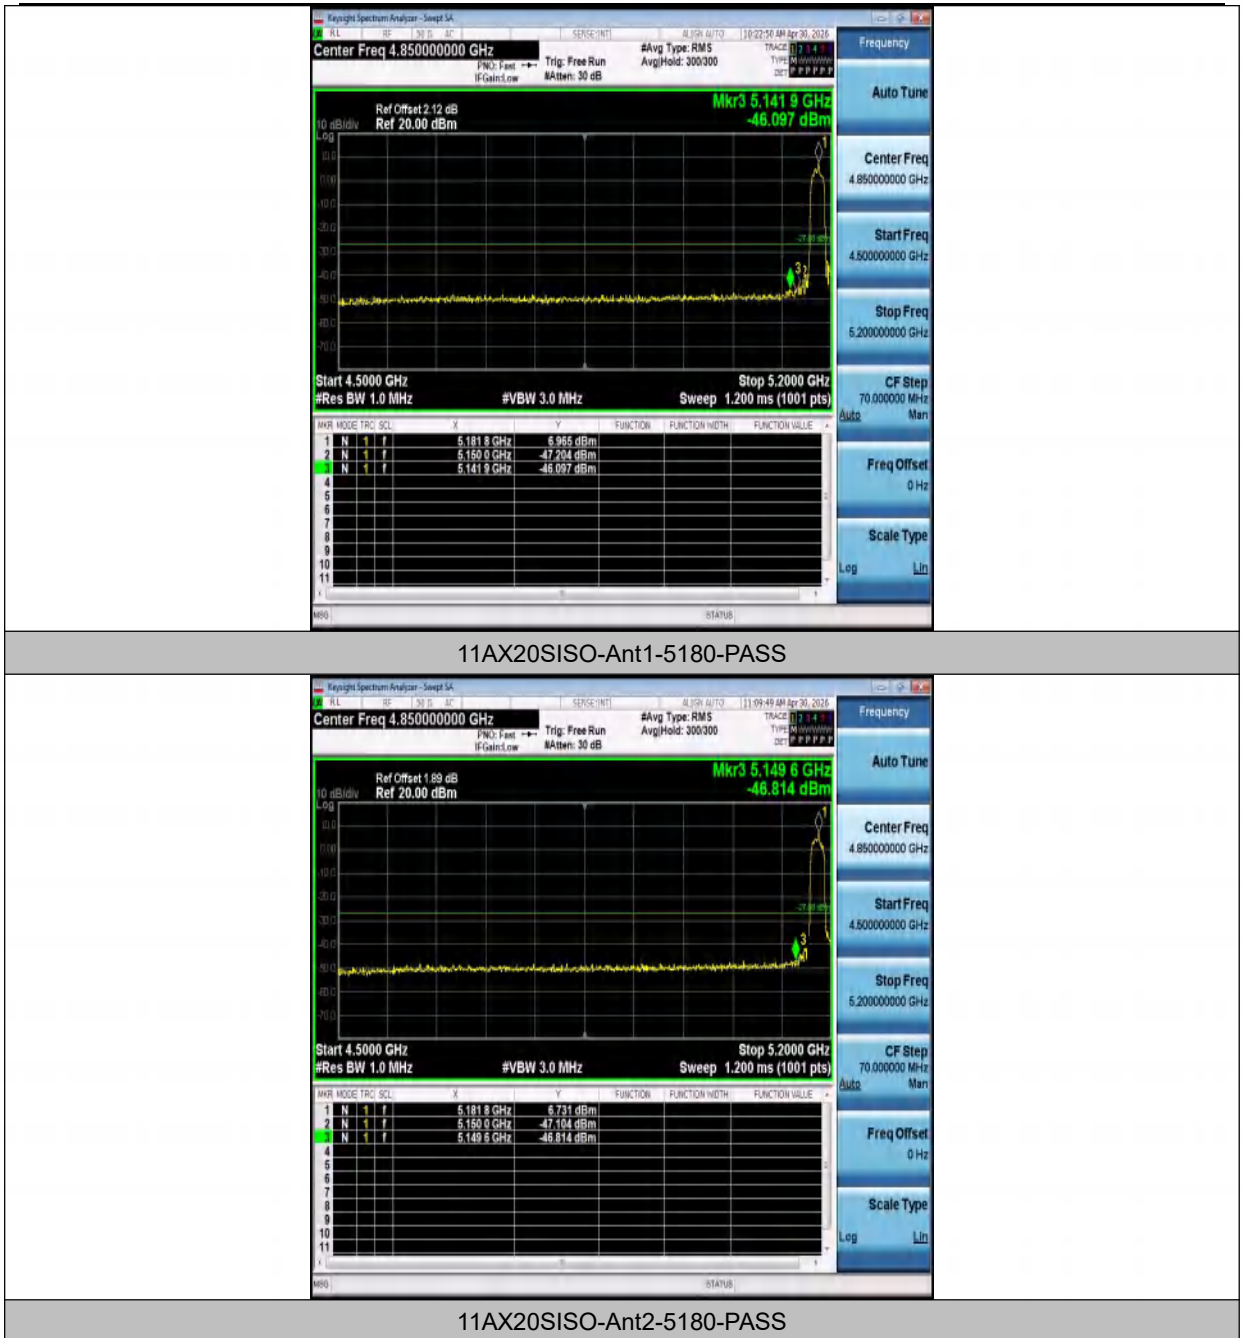



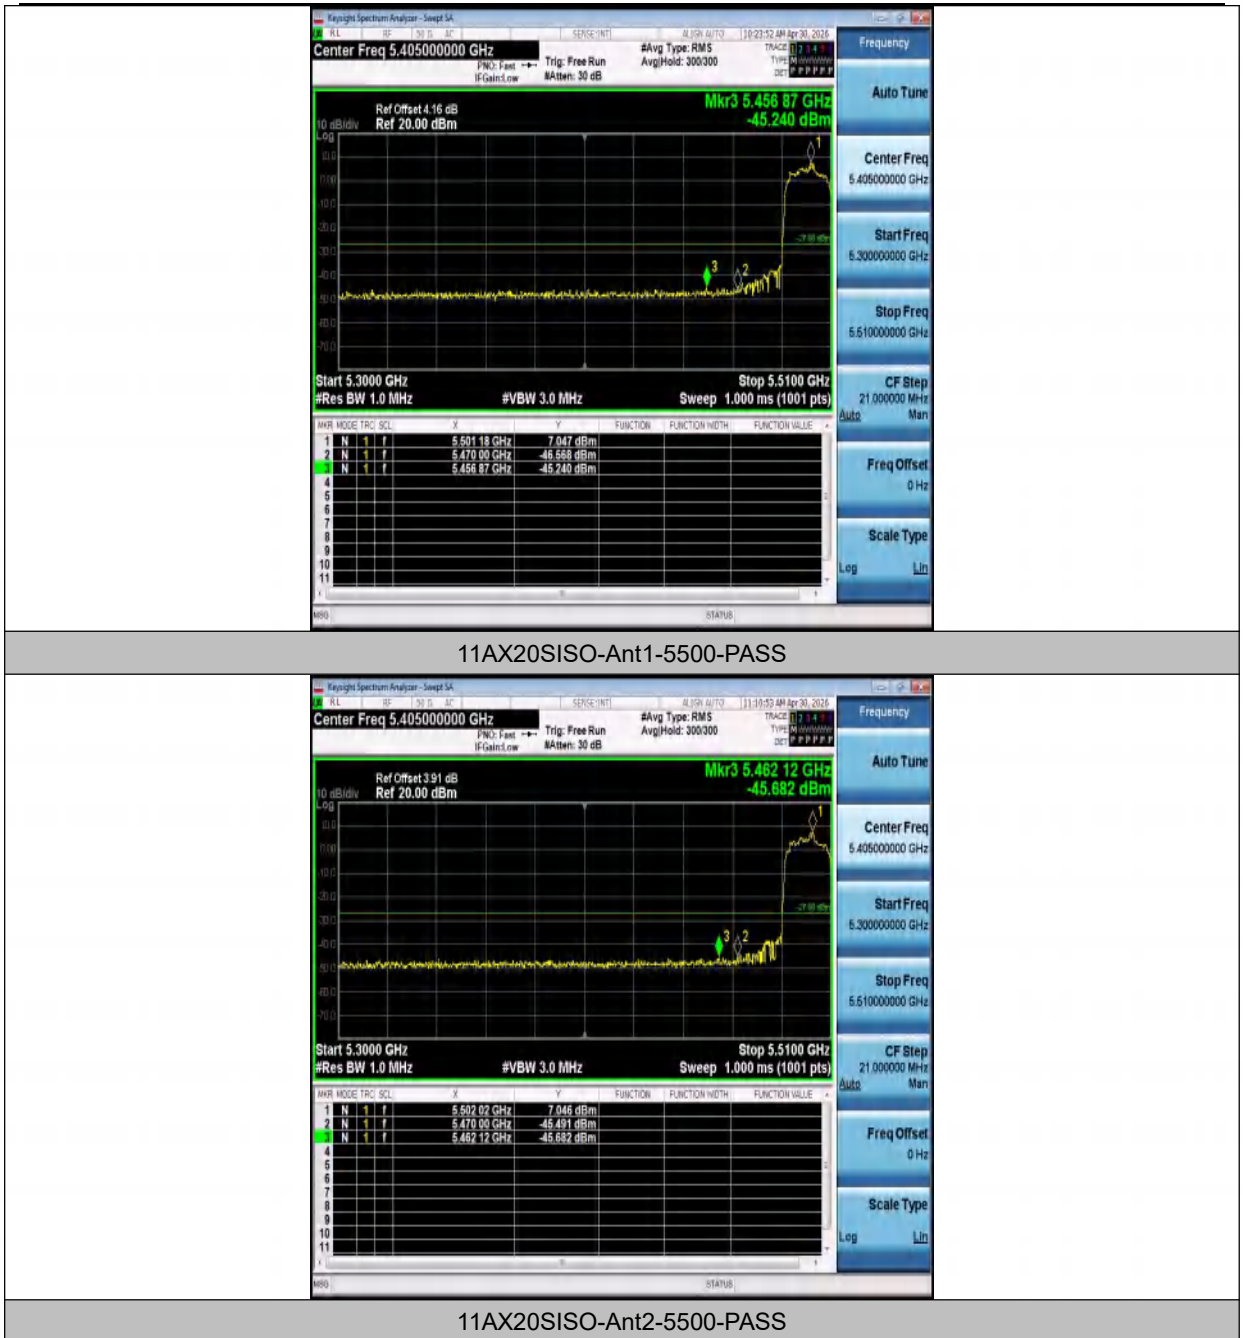



Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



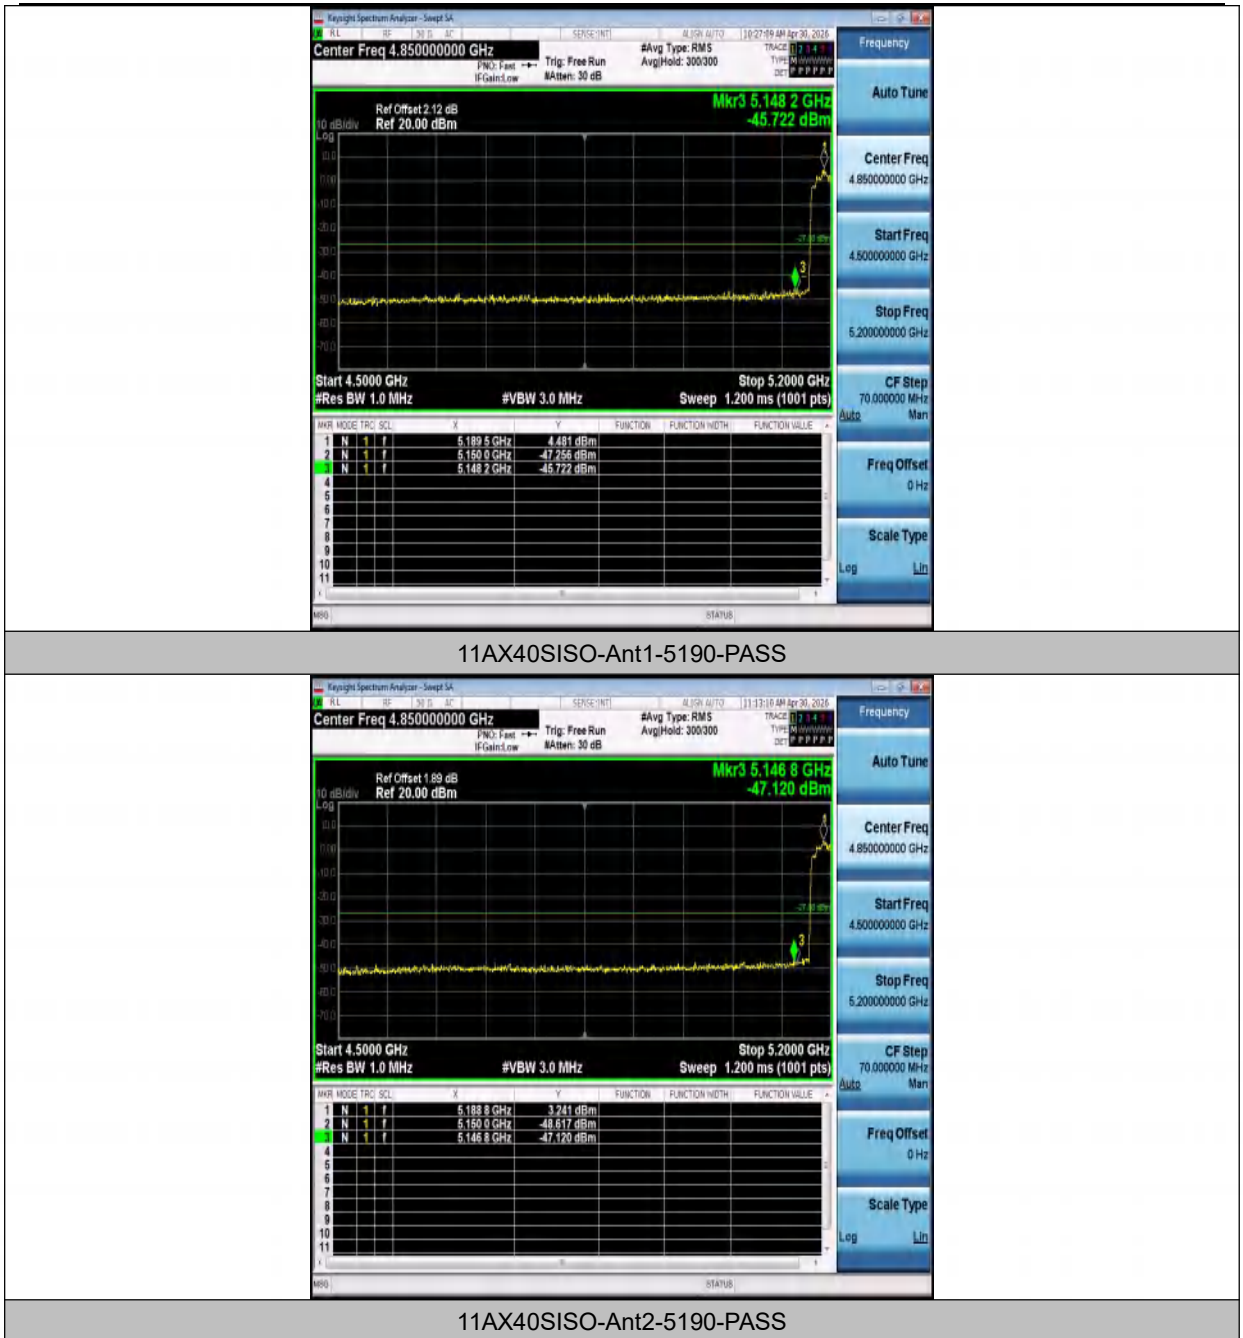

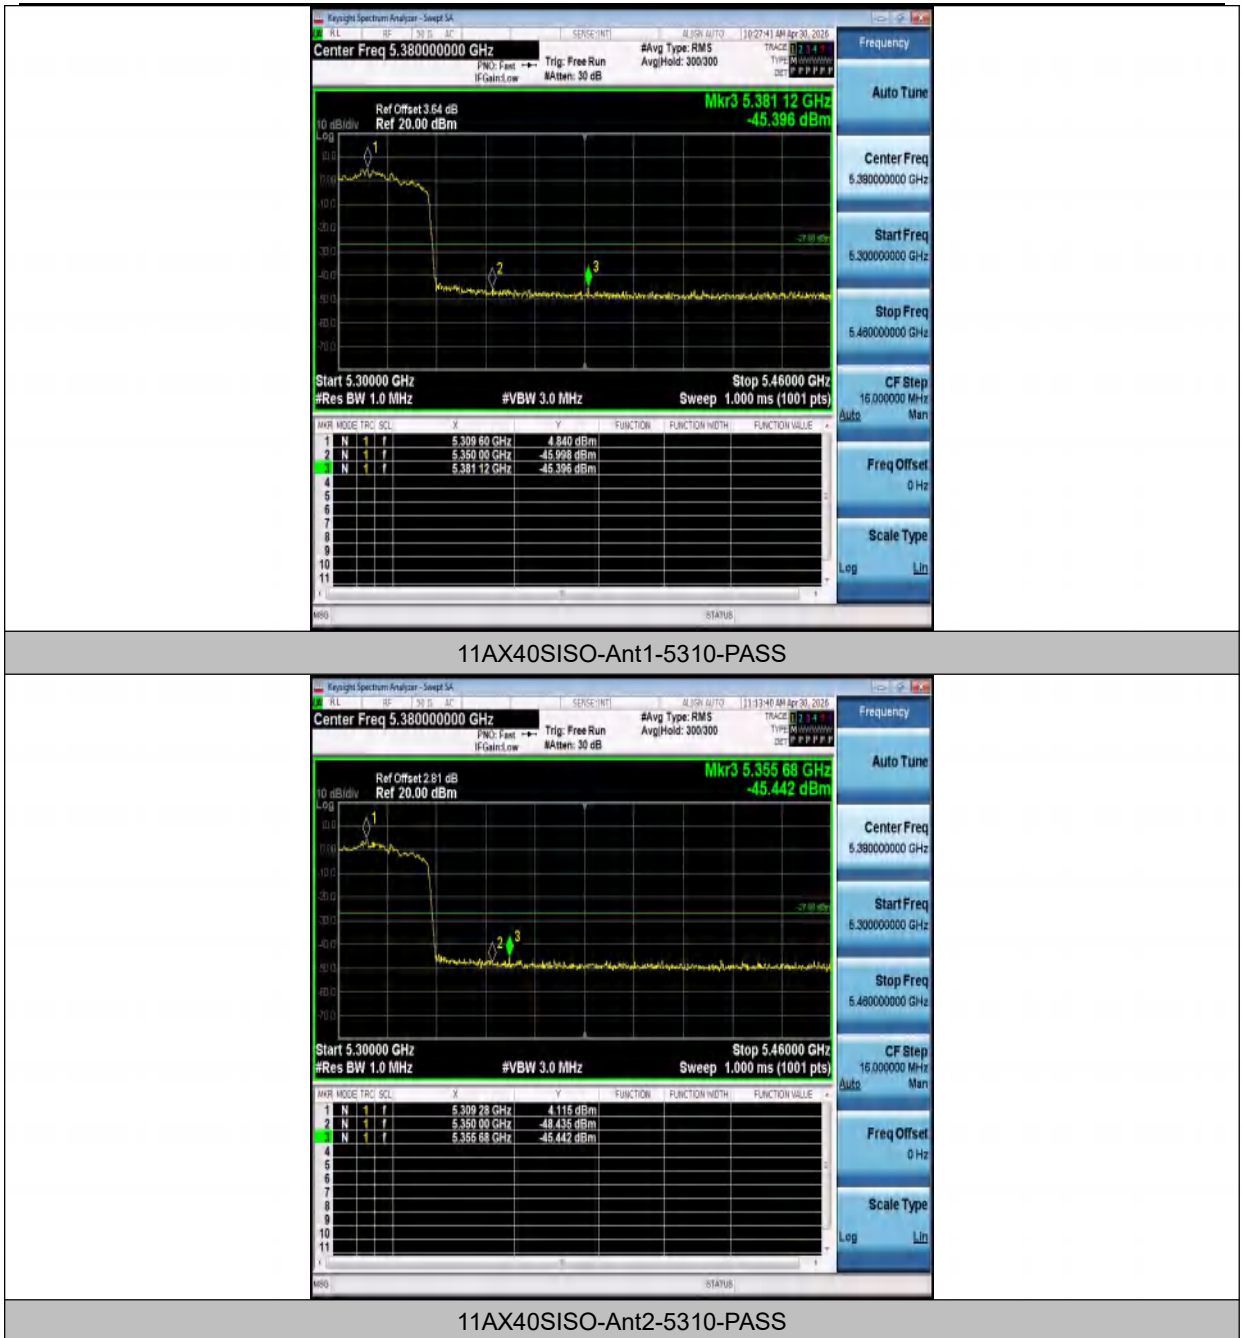

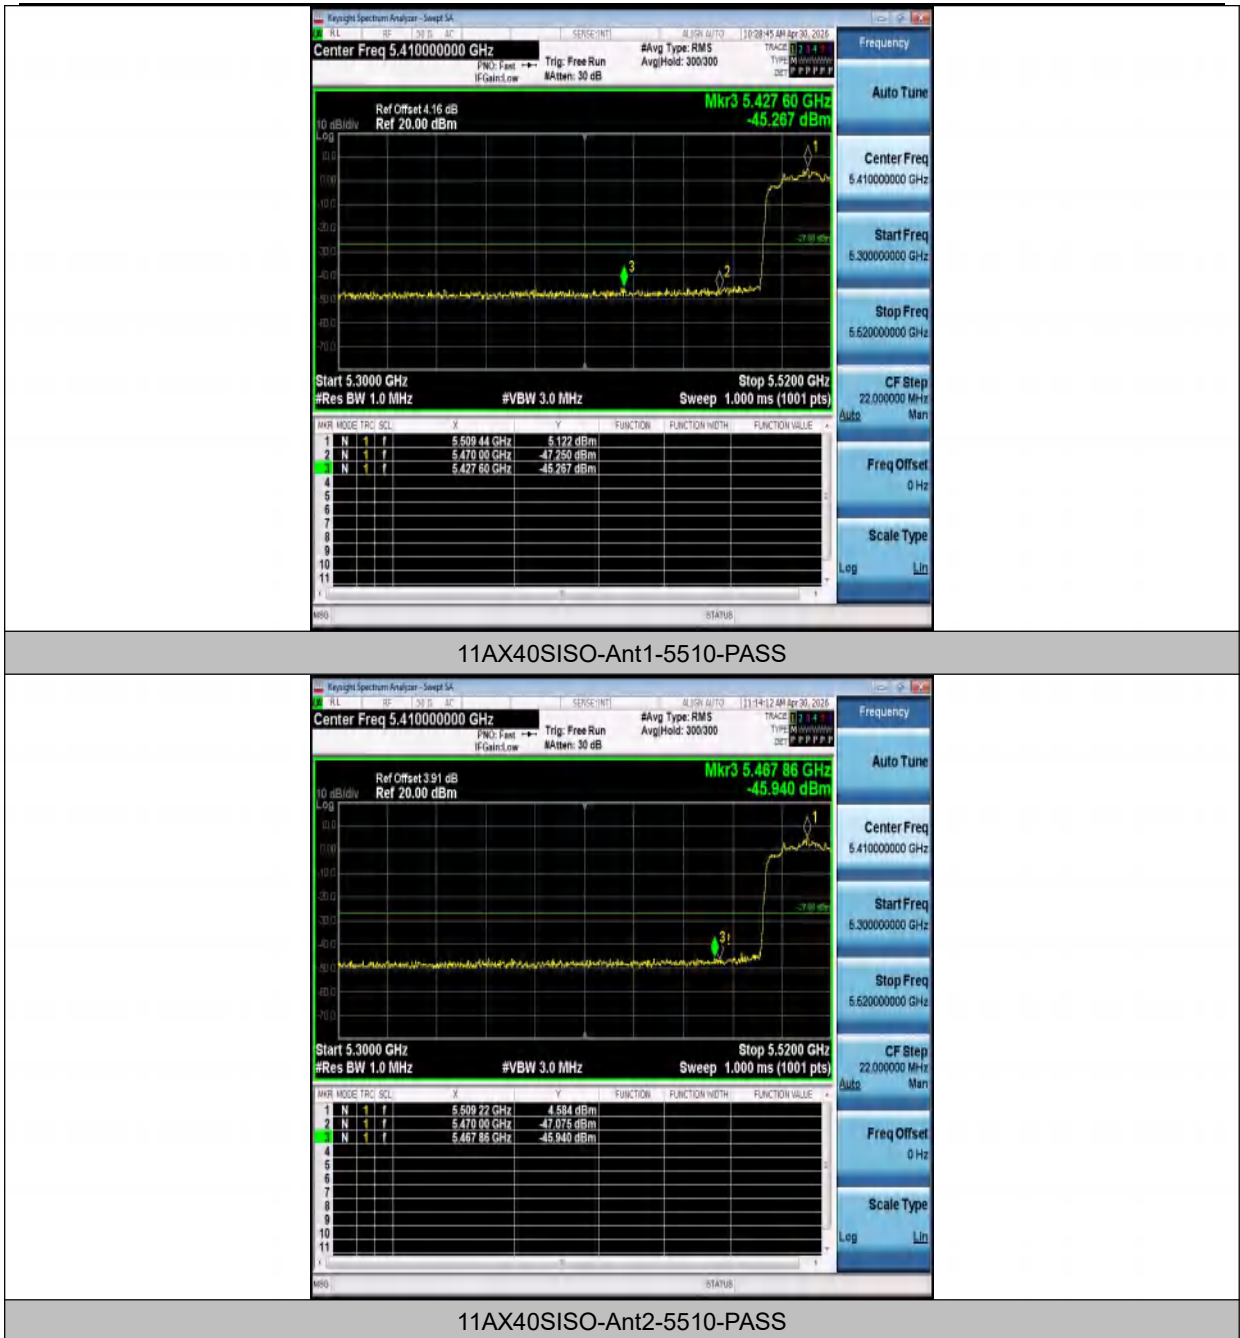


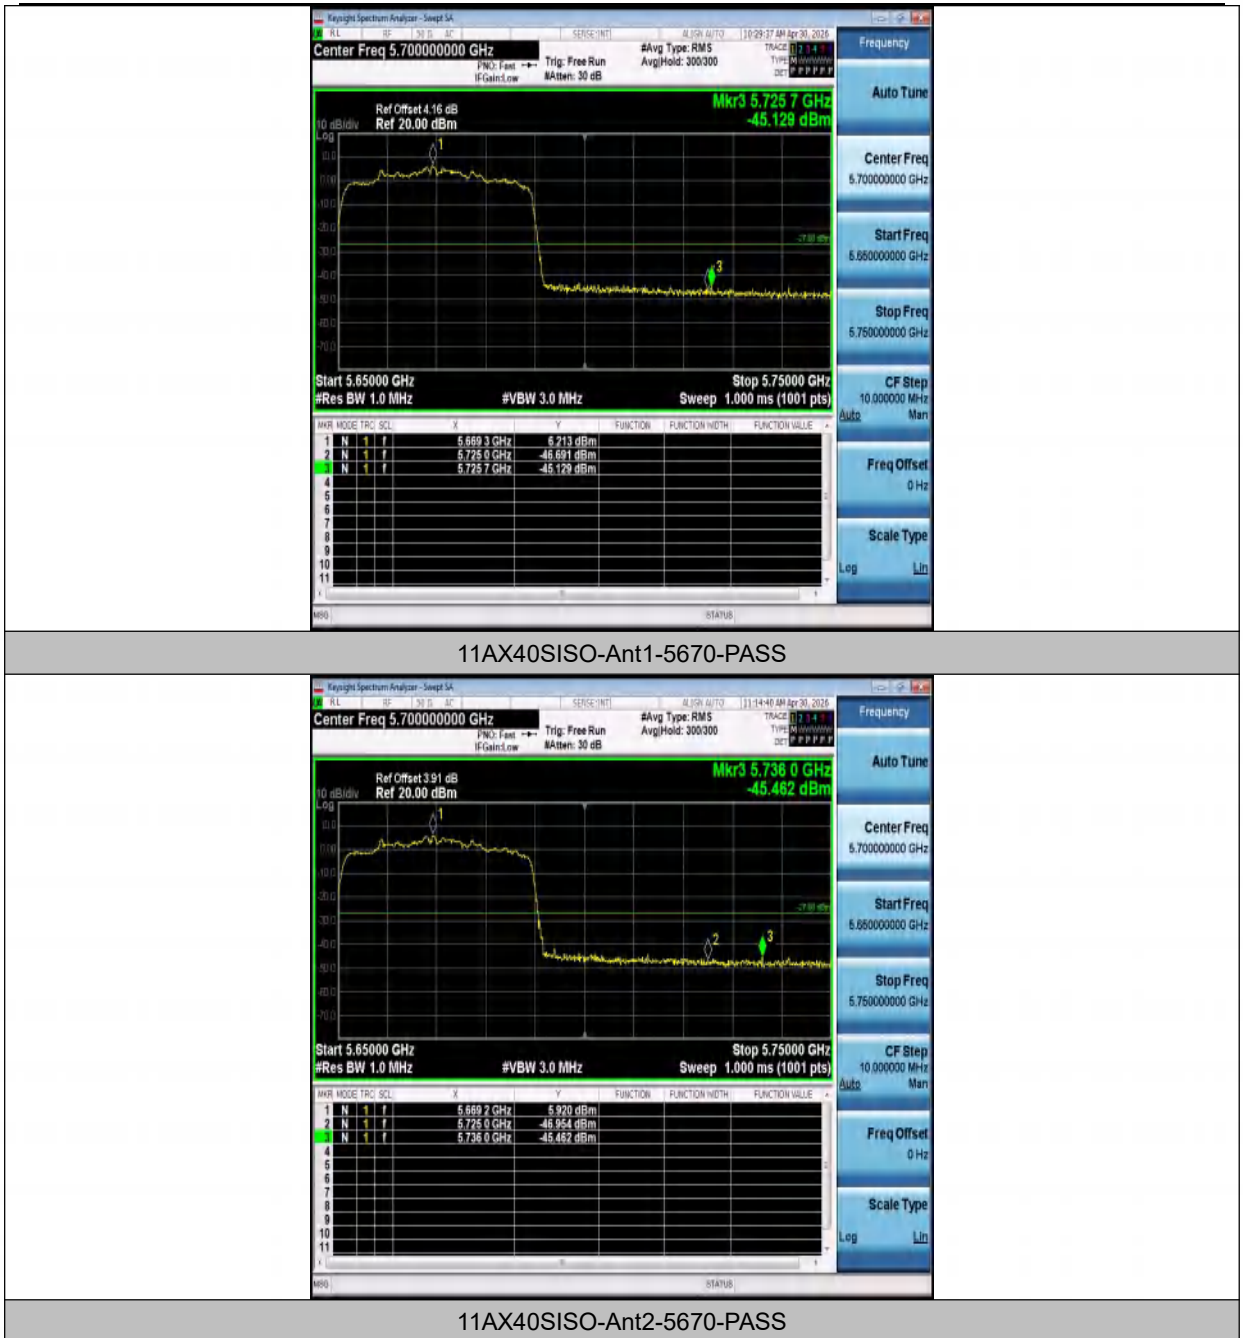


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

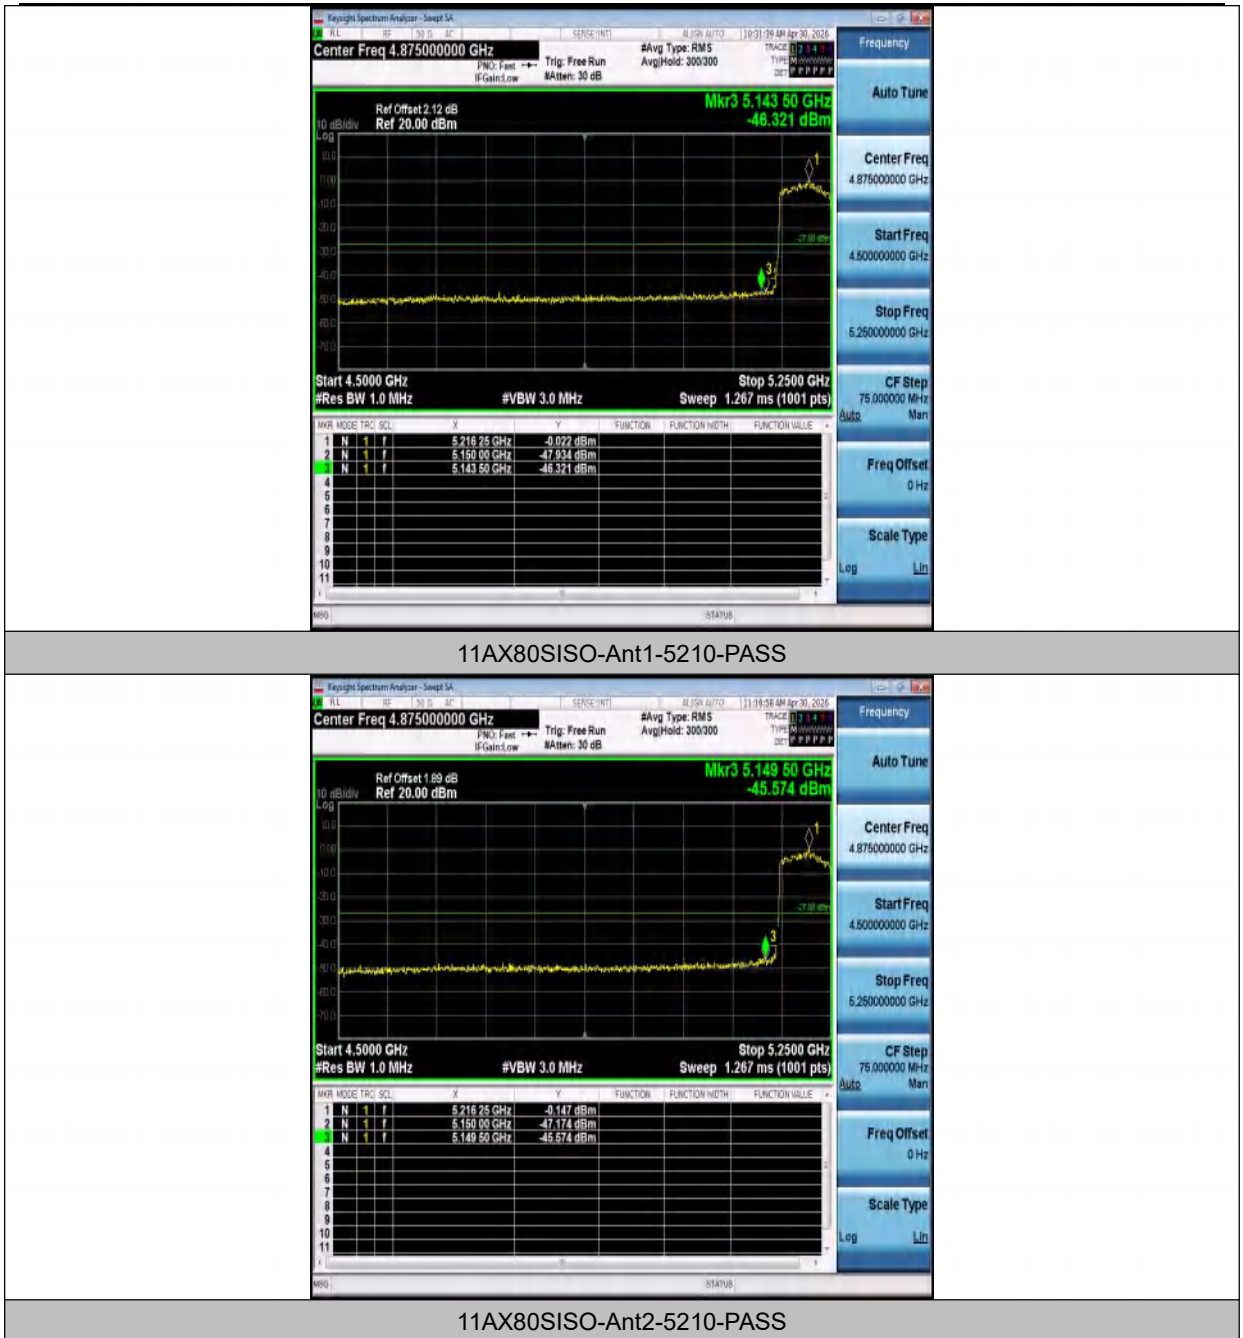


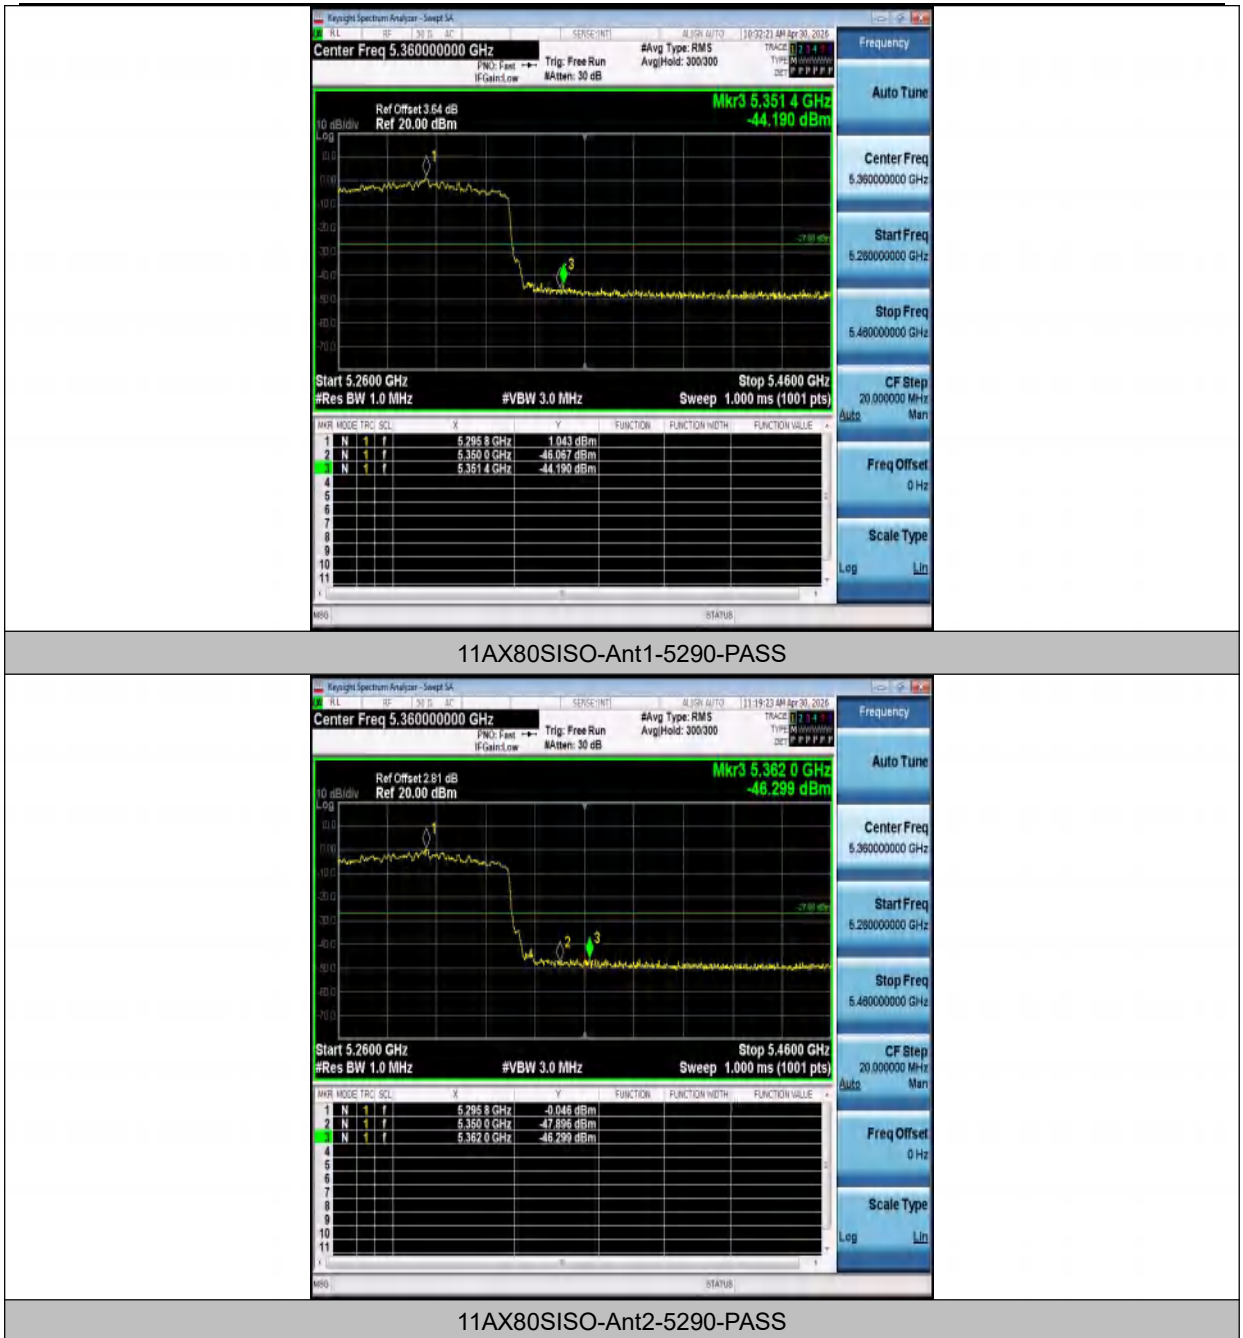






Test Graphs B4

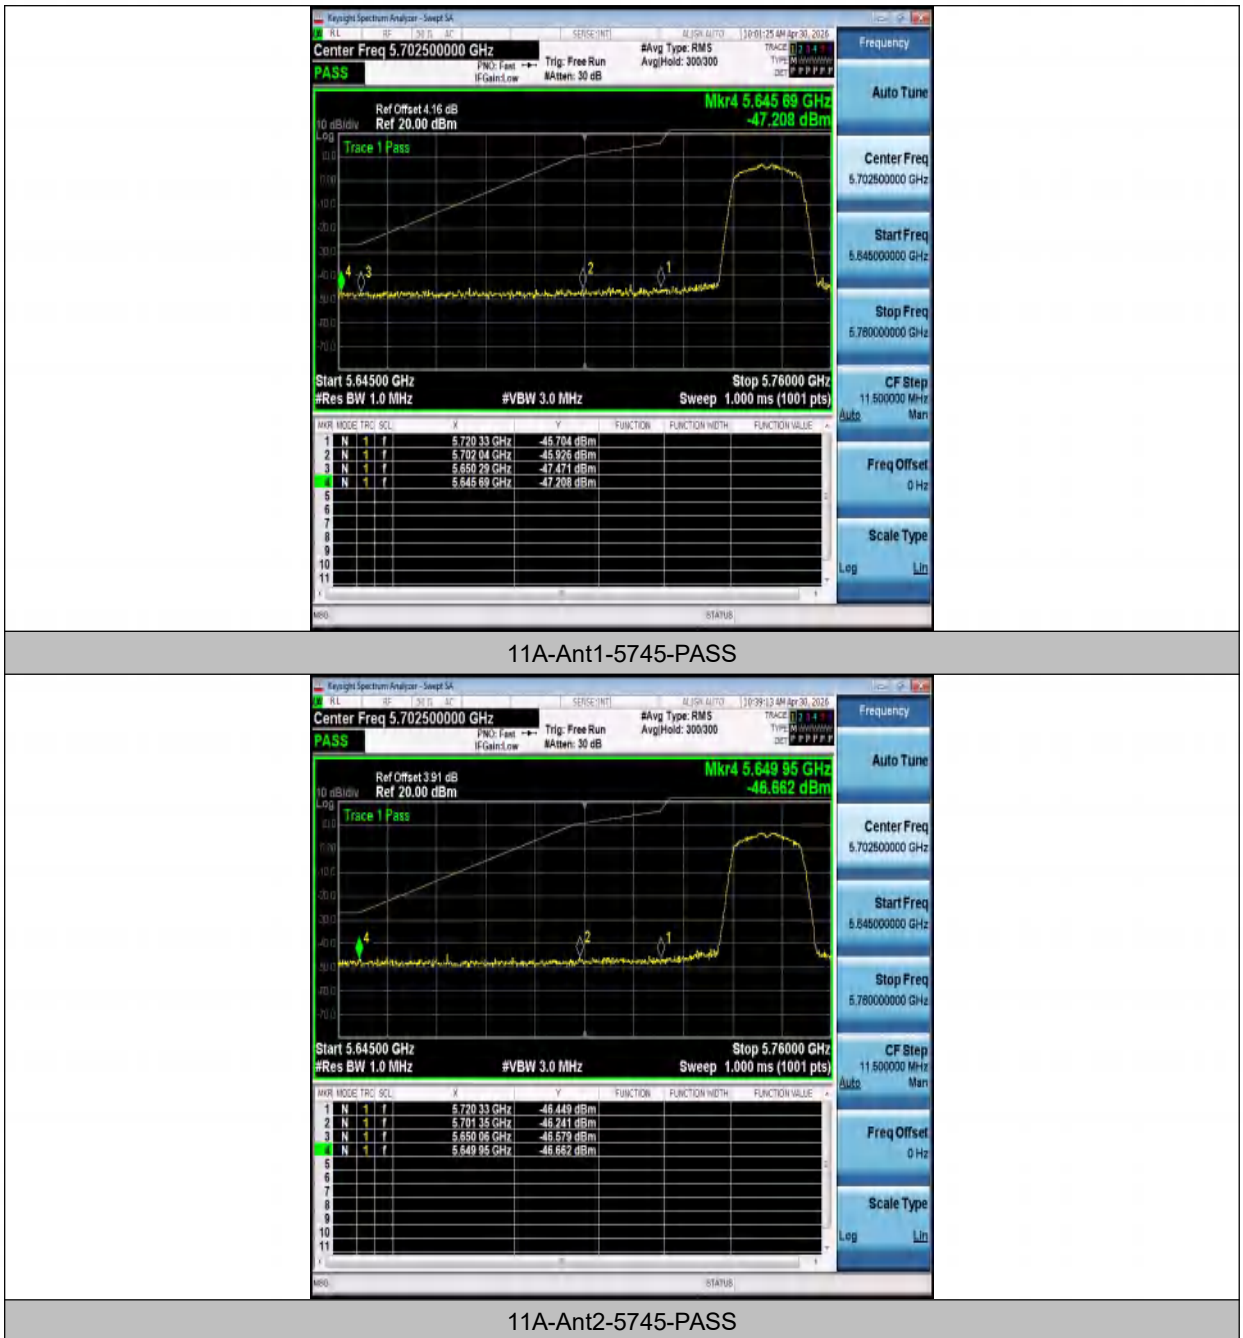

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

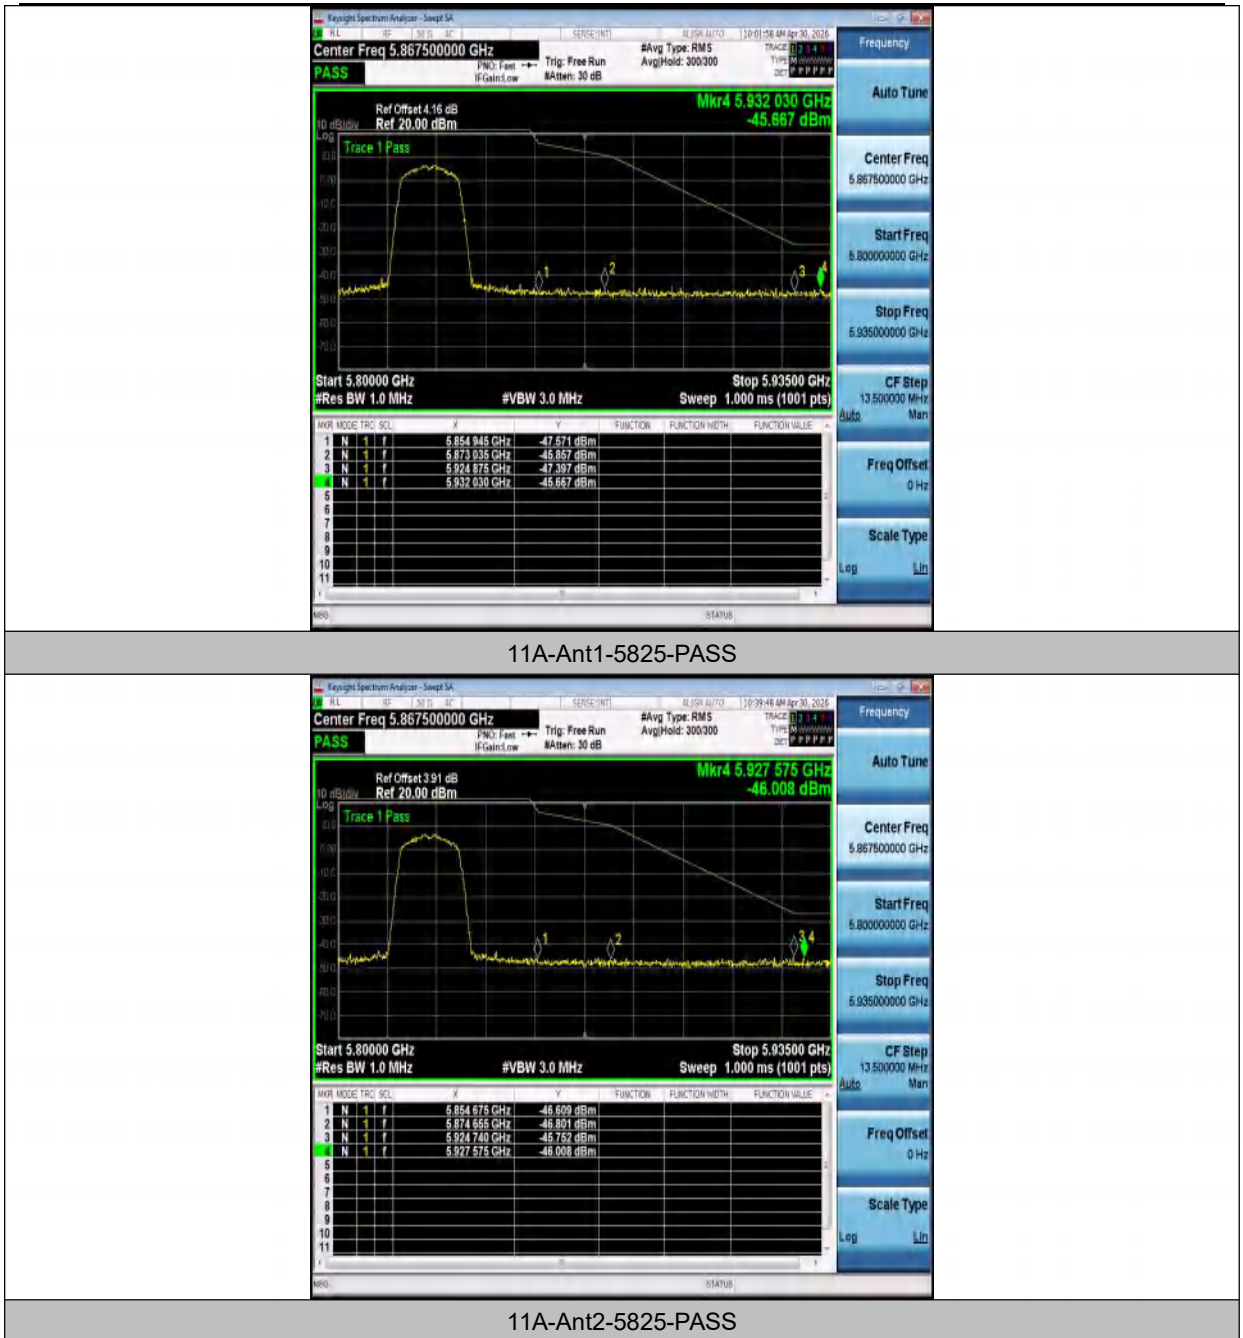






11N20SISO-Ant1-5745-PASS



11N20SISO-Ant2-5745-PASS

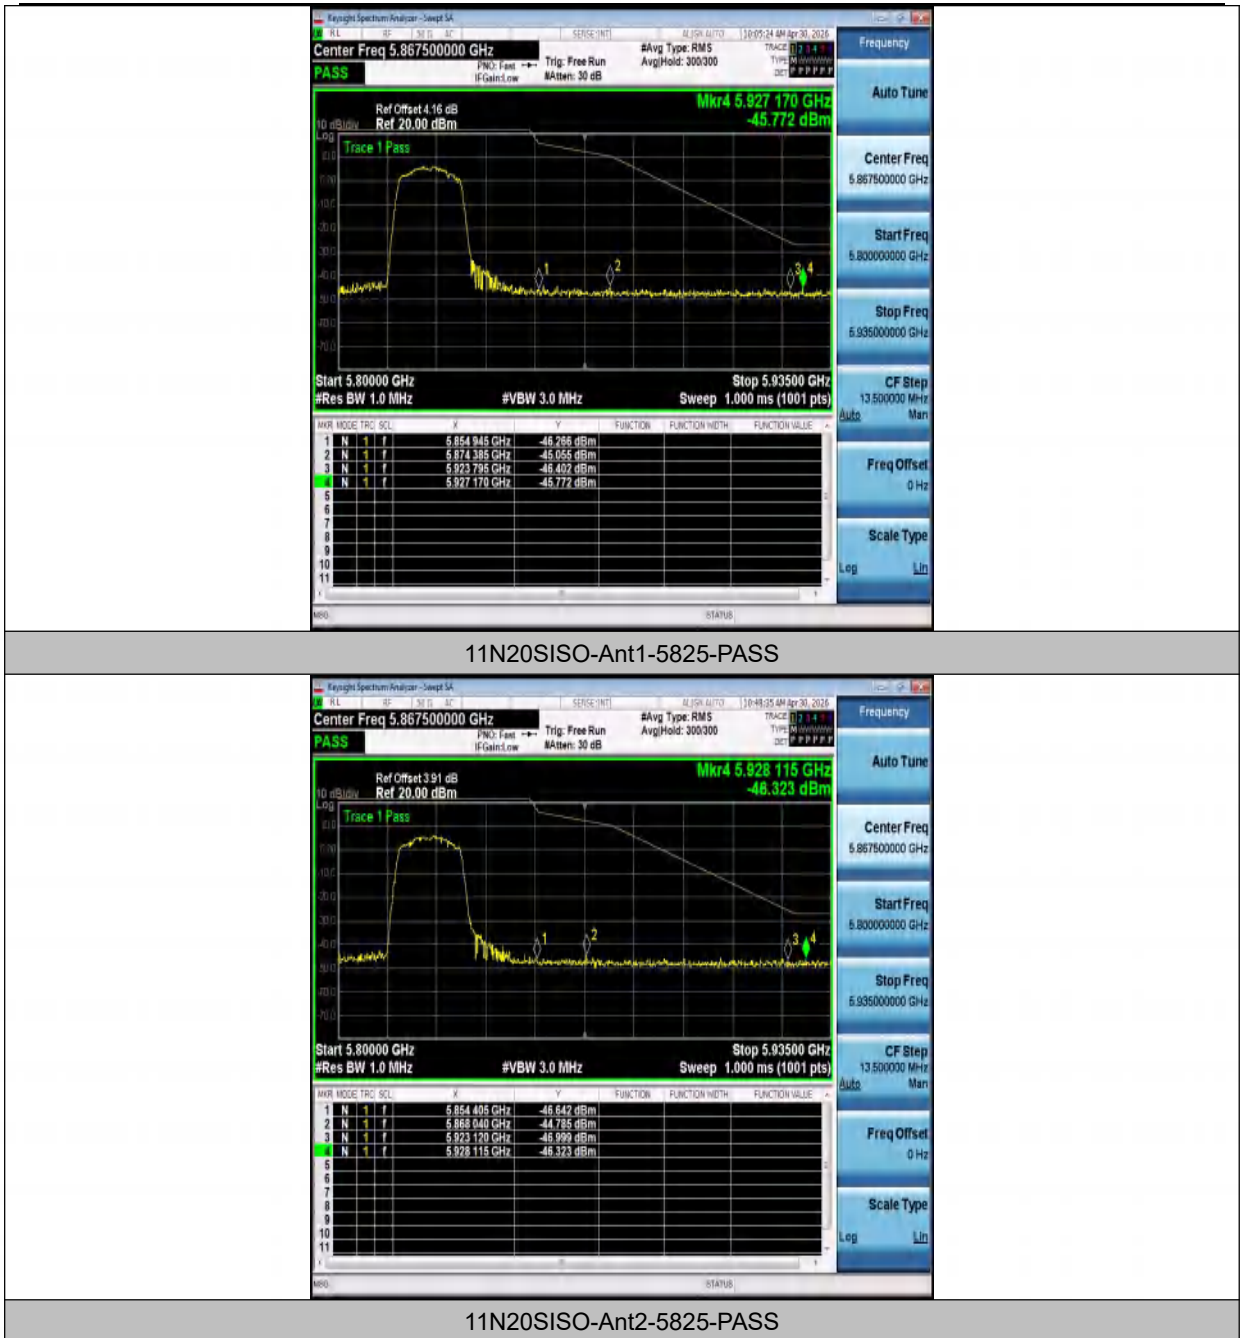

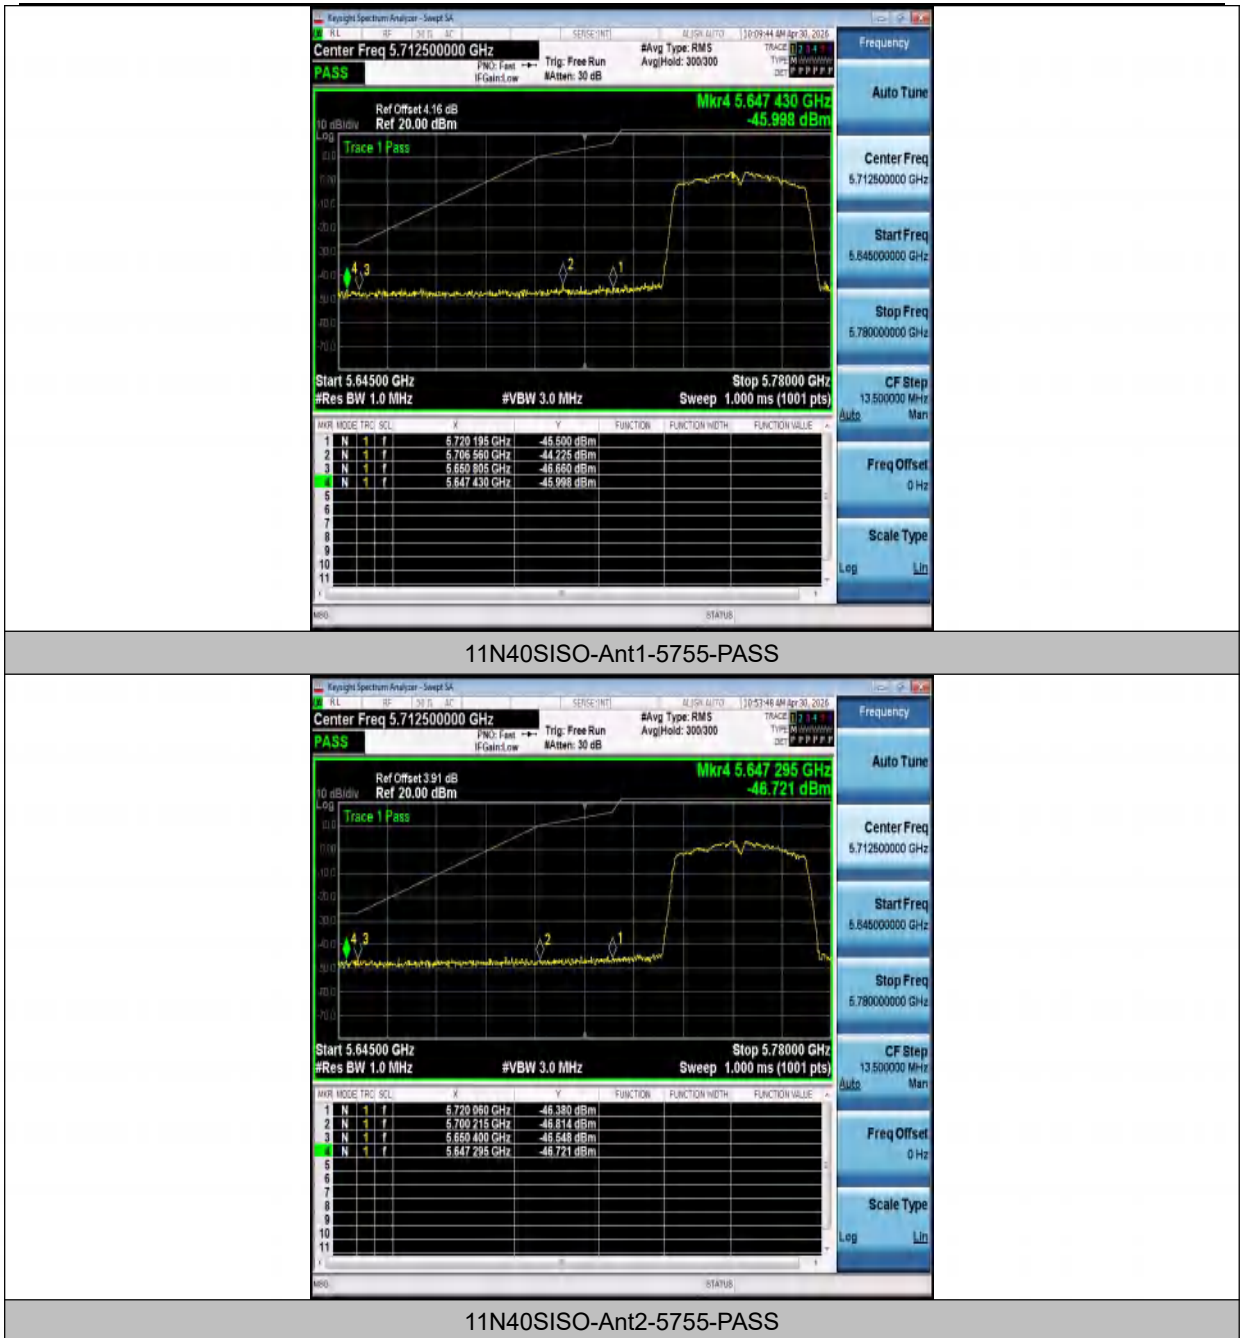


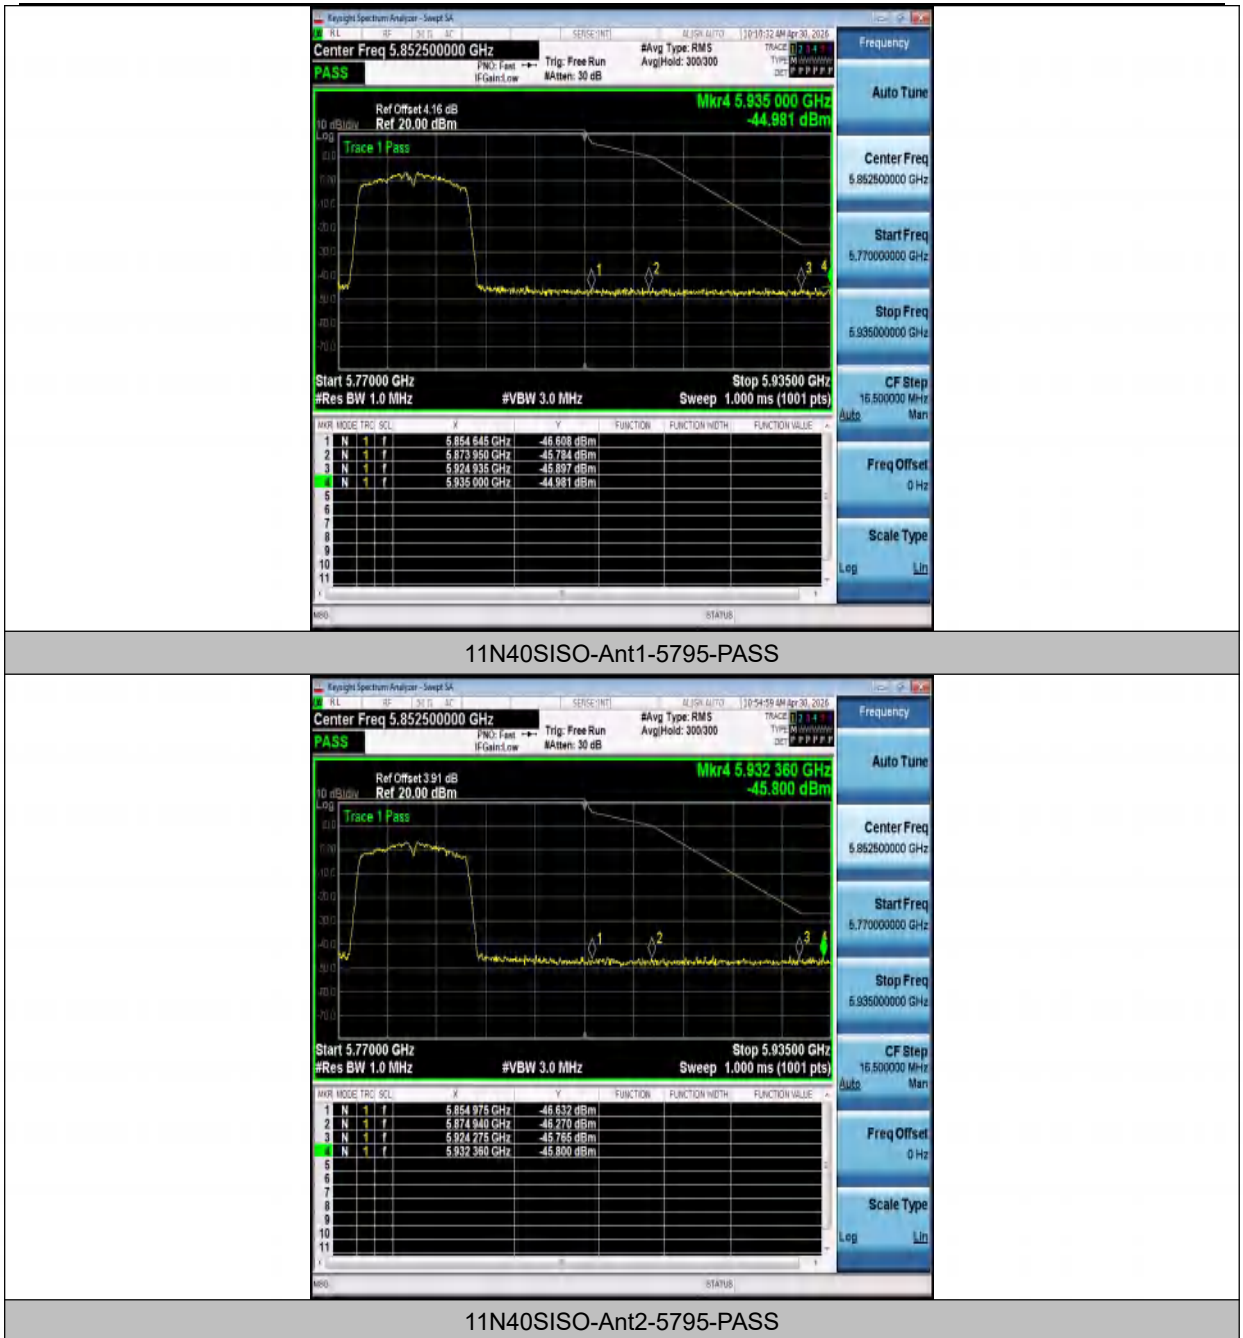

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

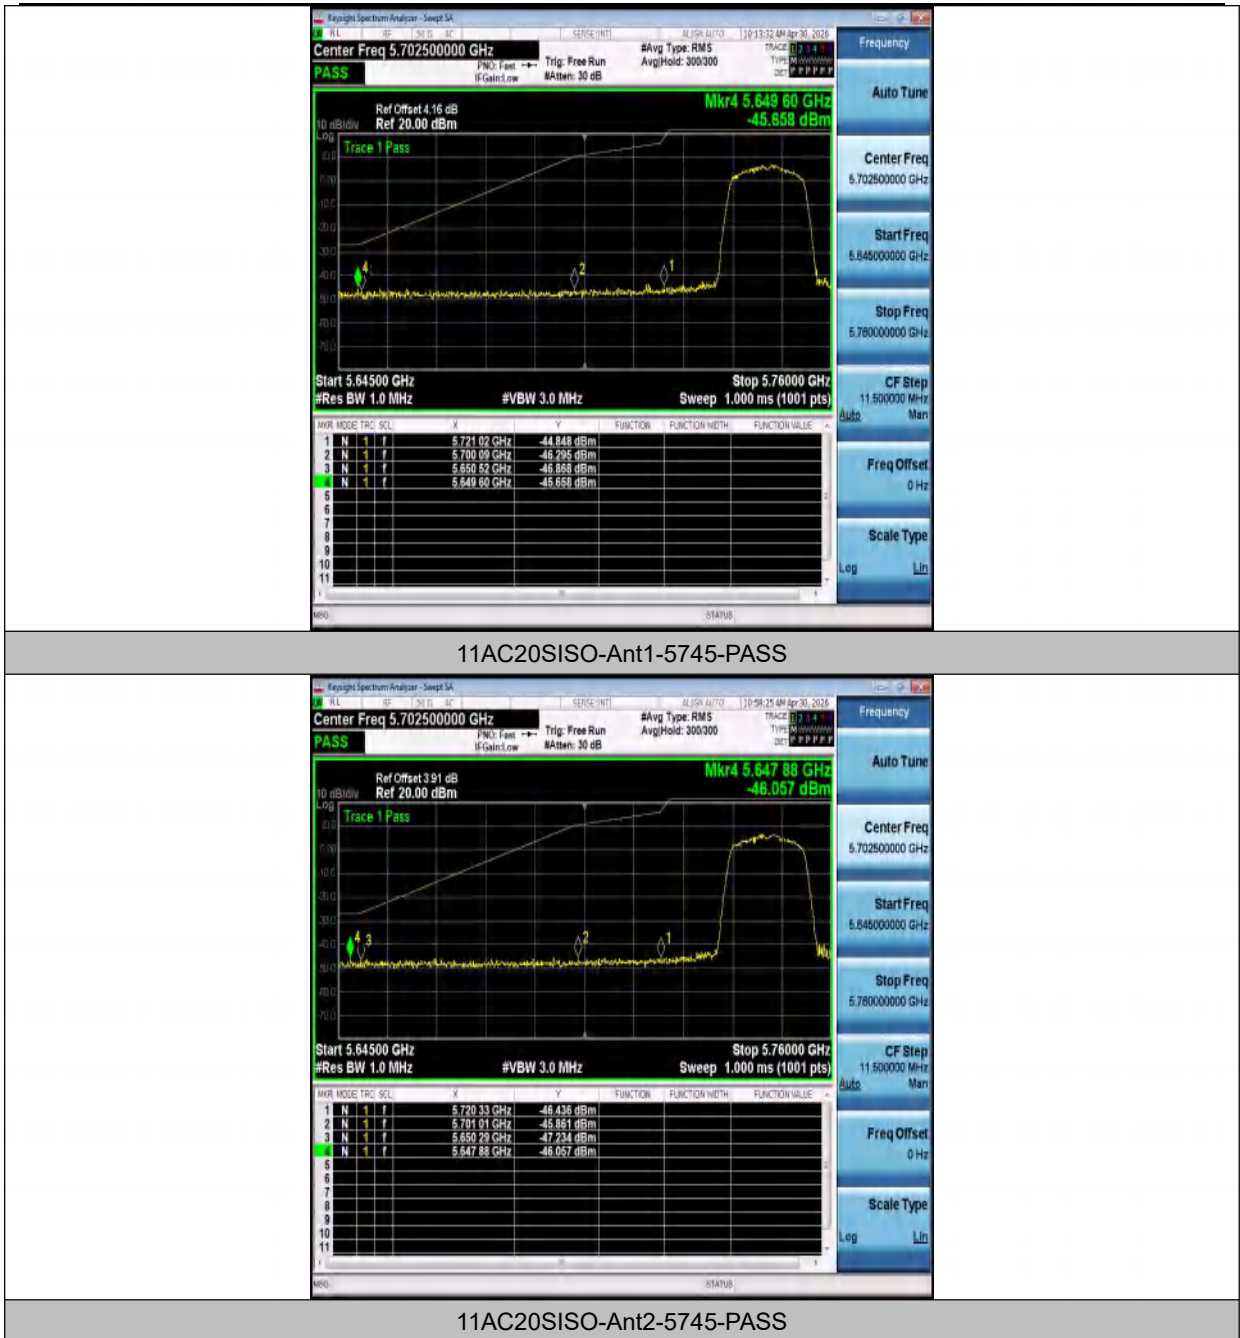



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

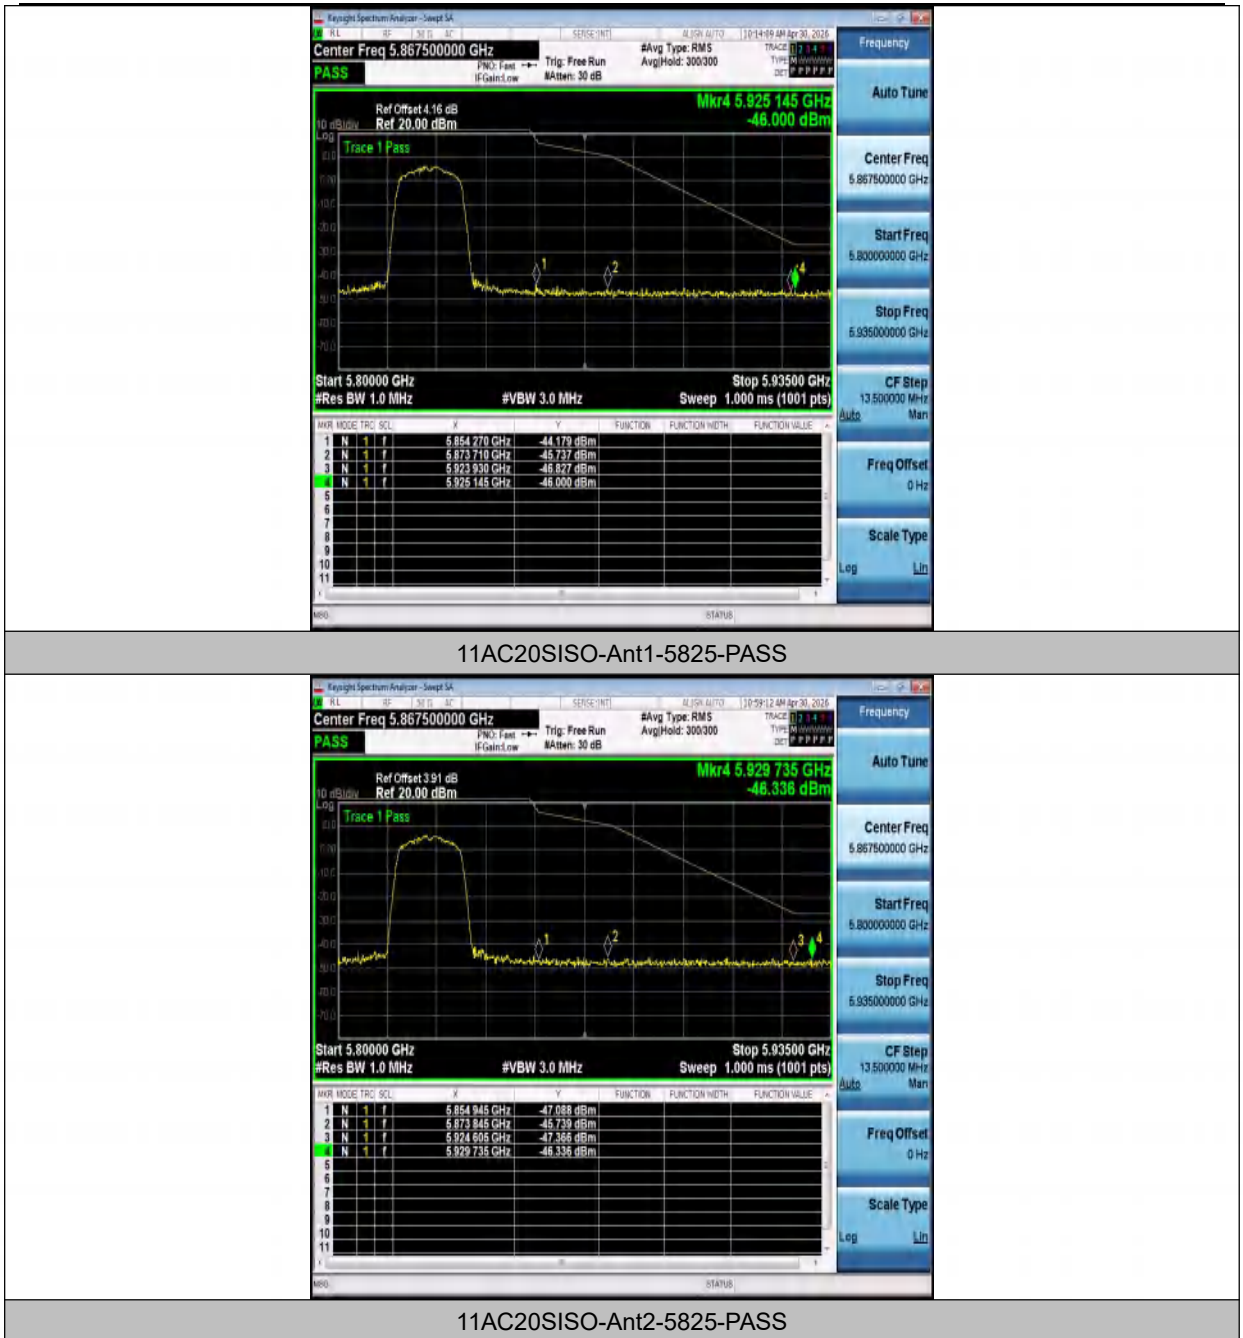

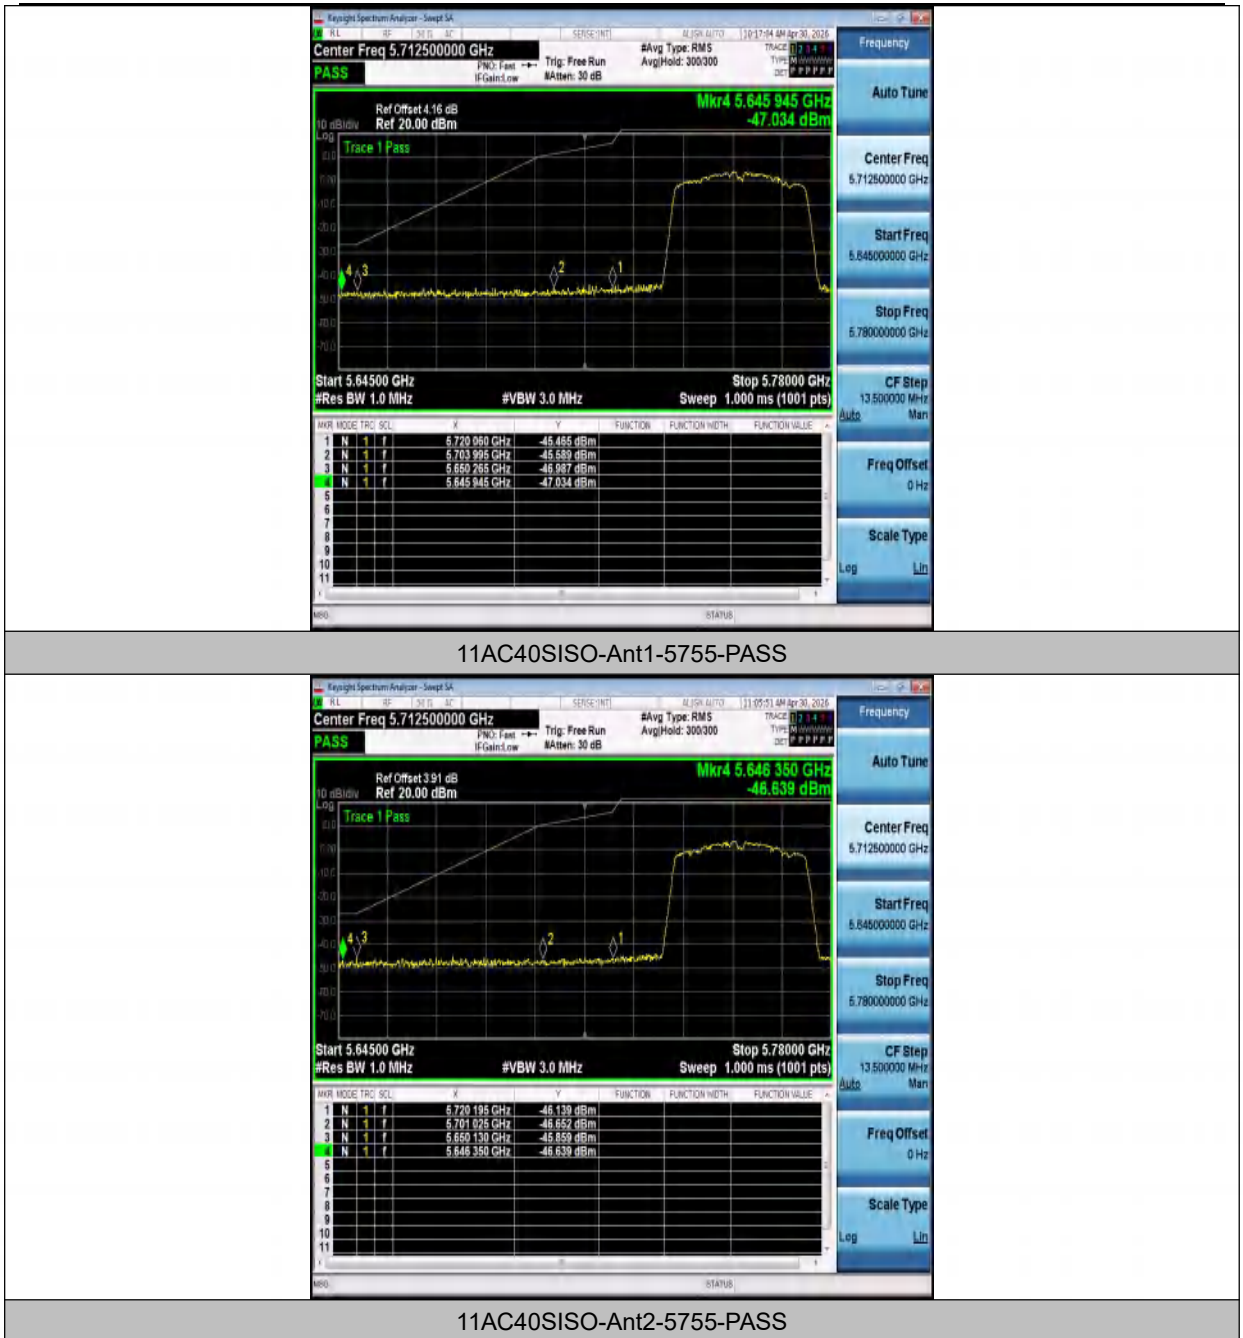


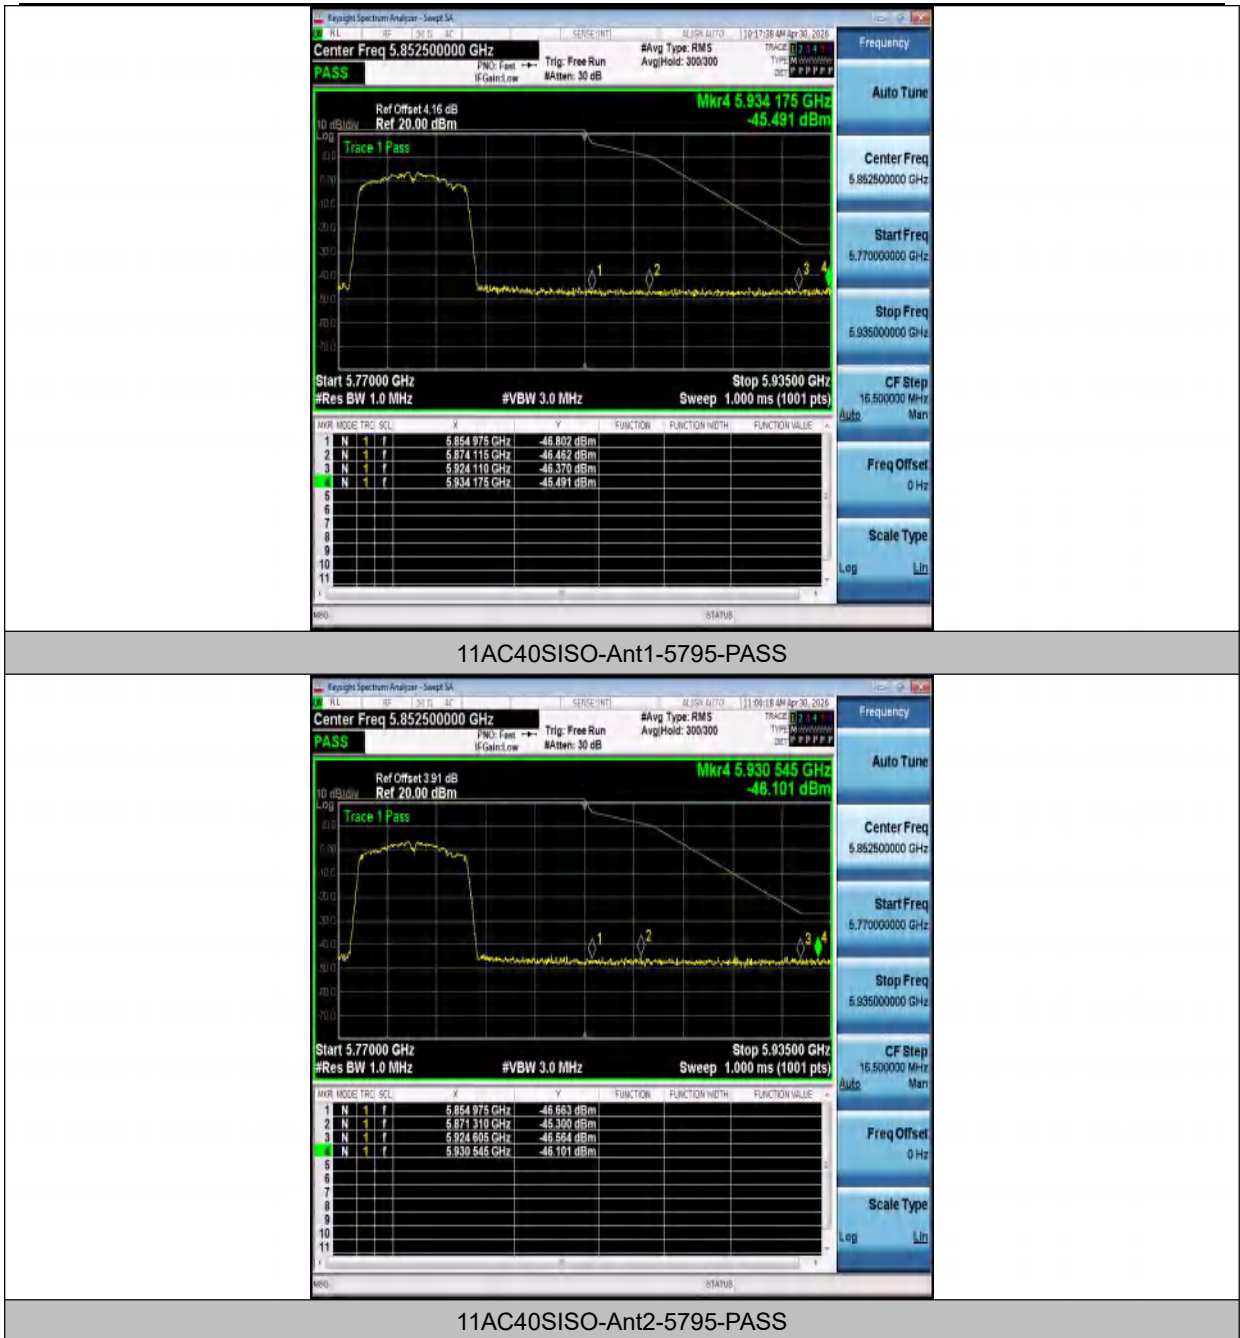








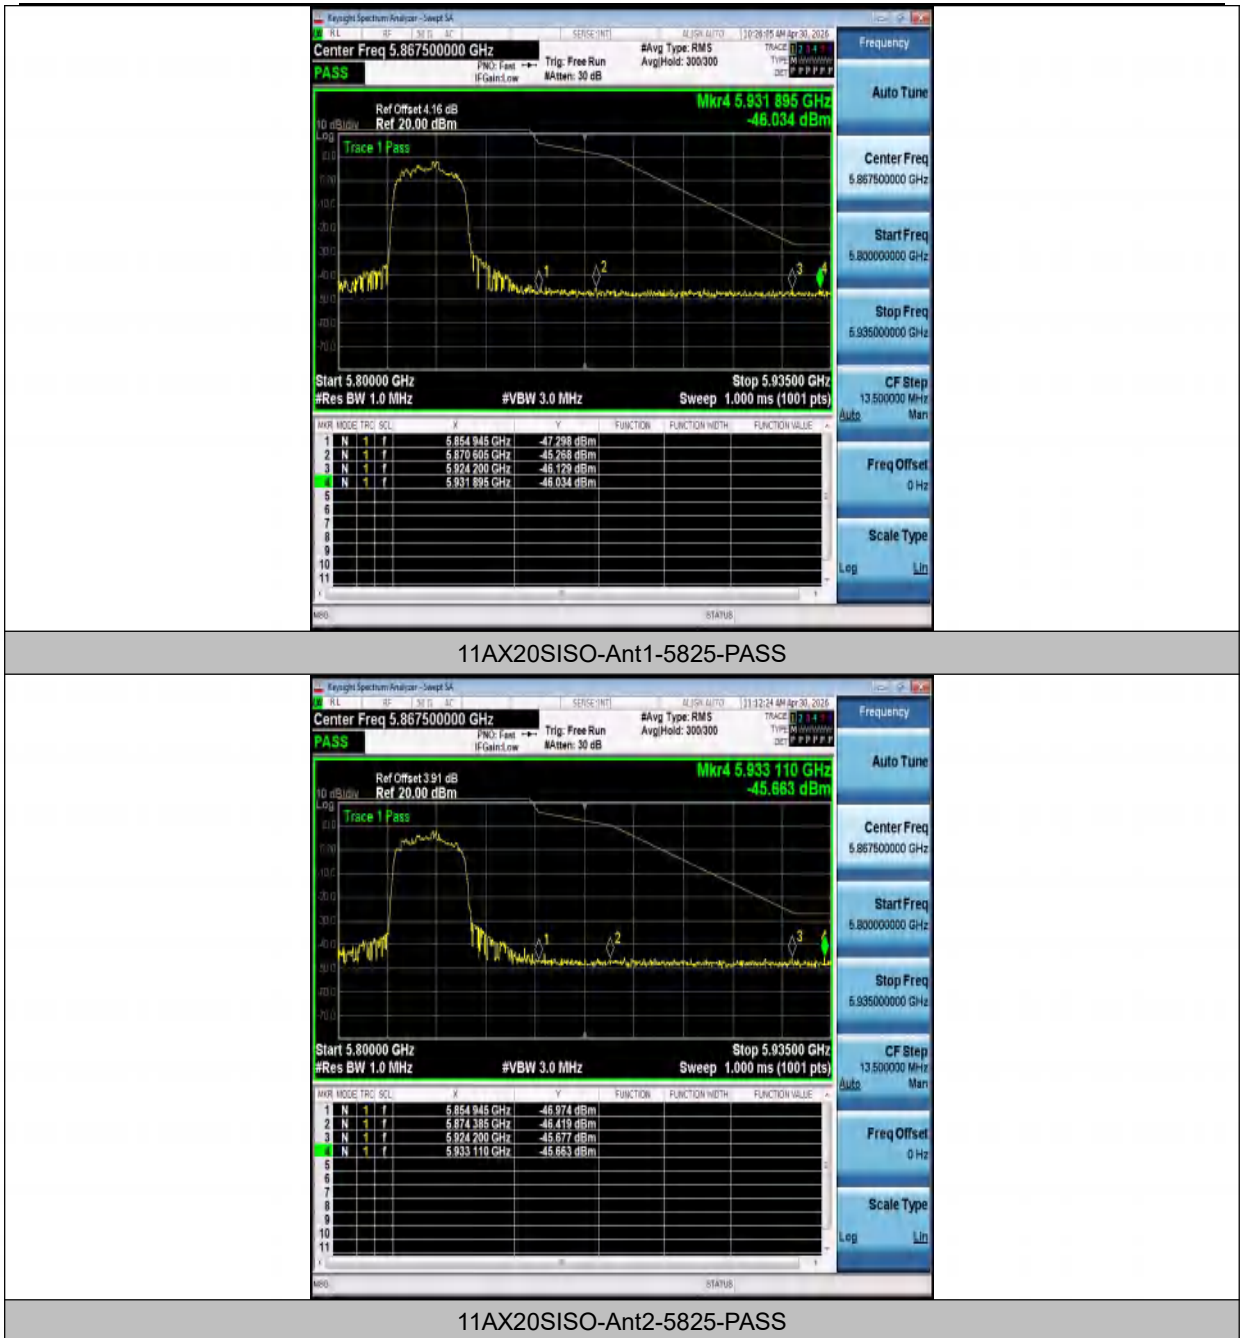


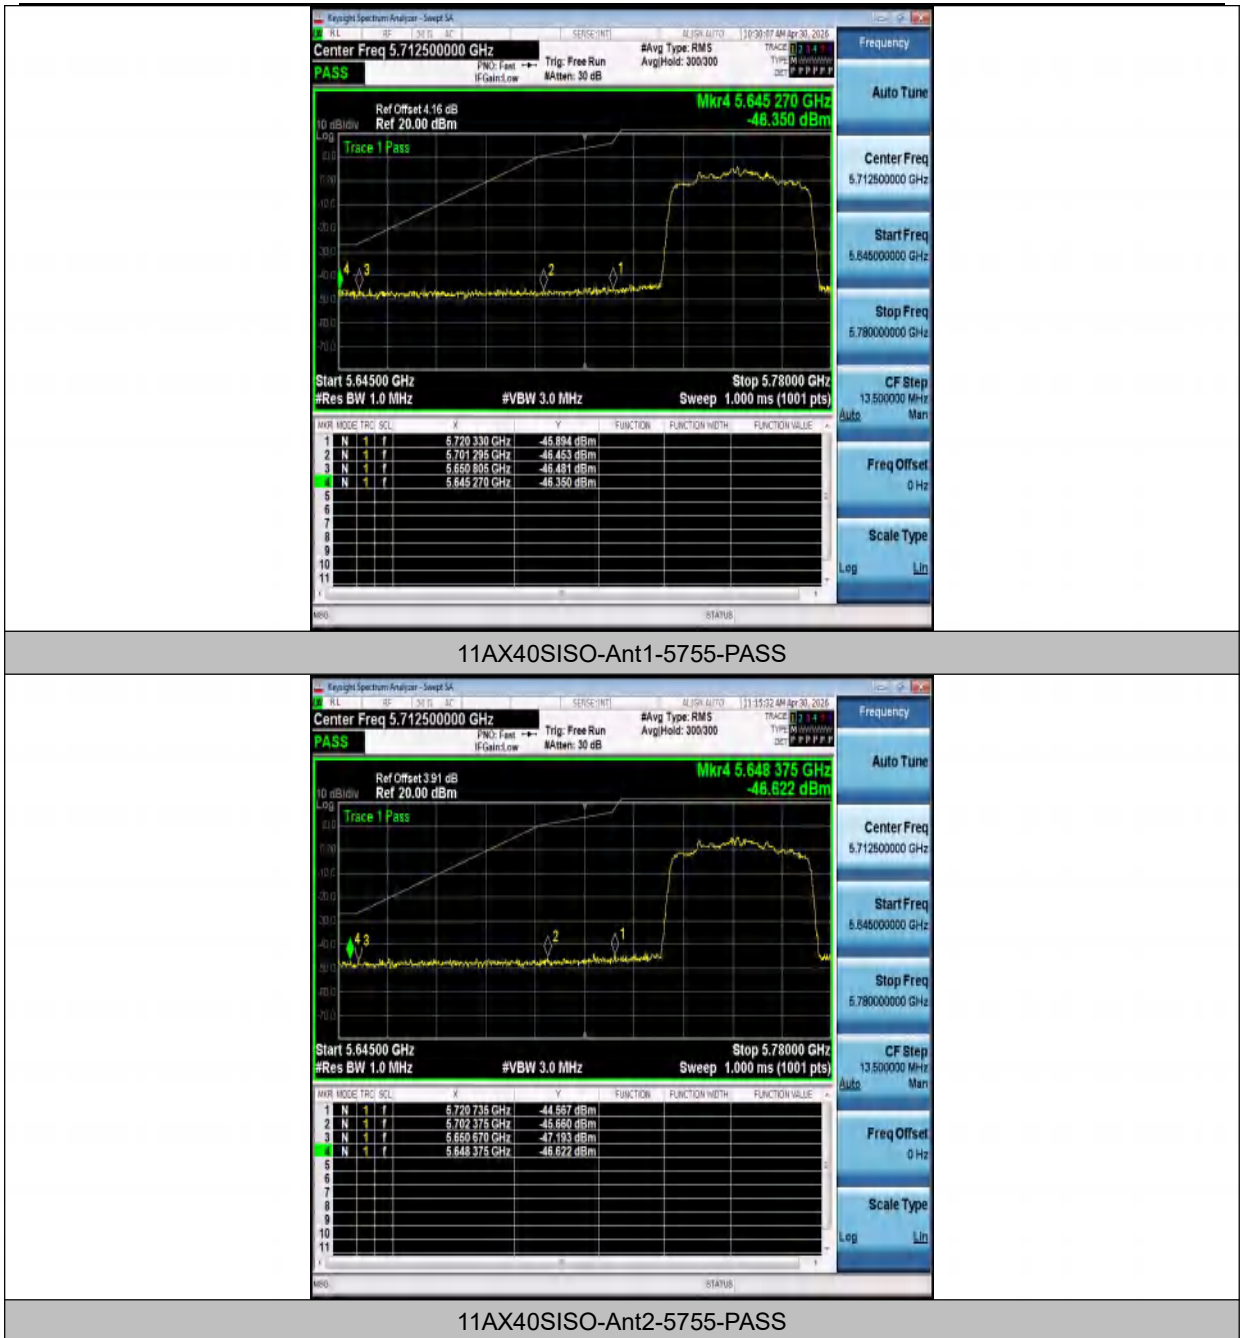

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

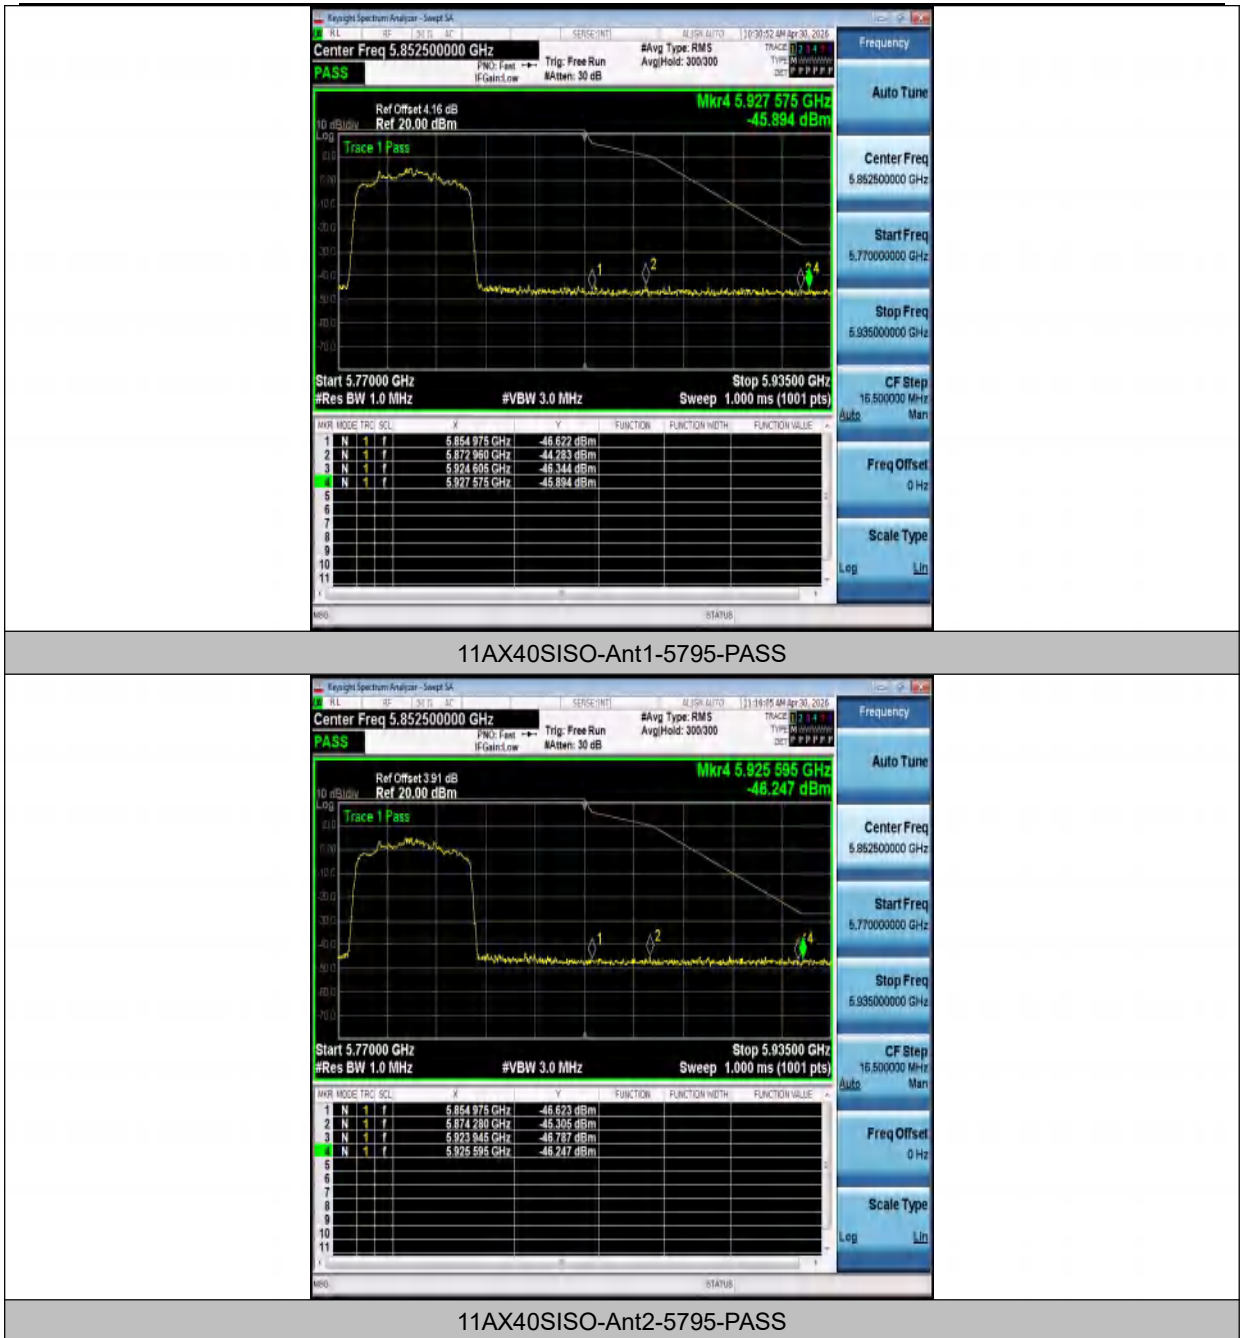


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

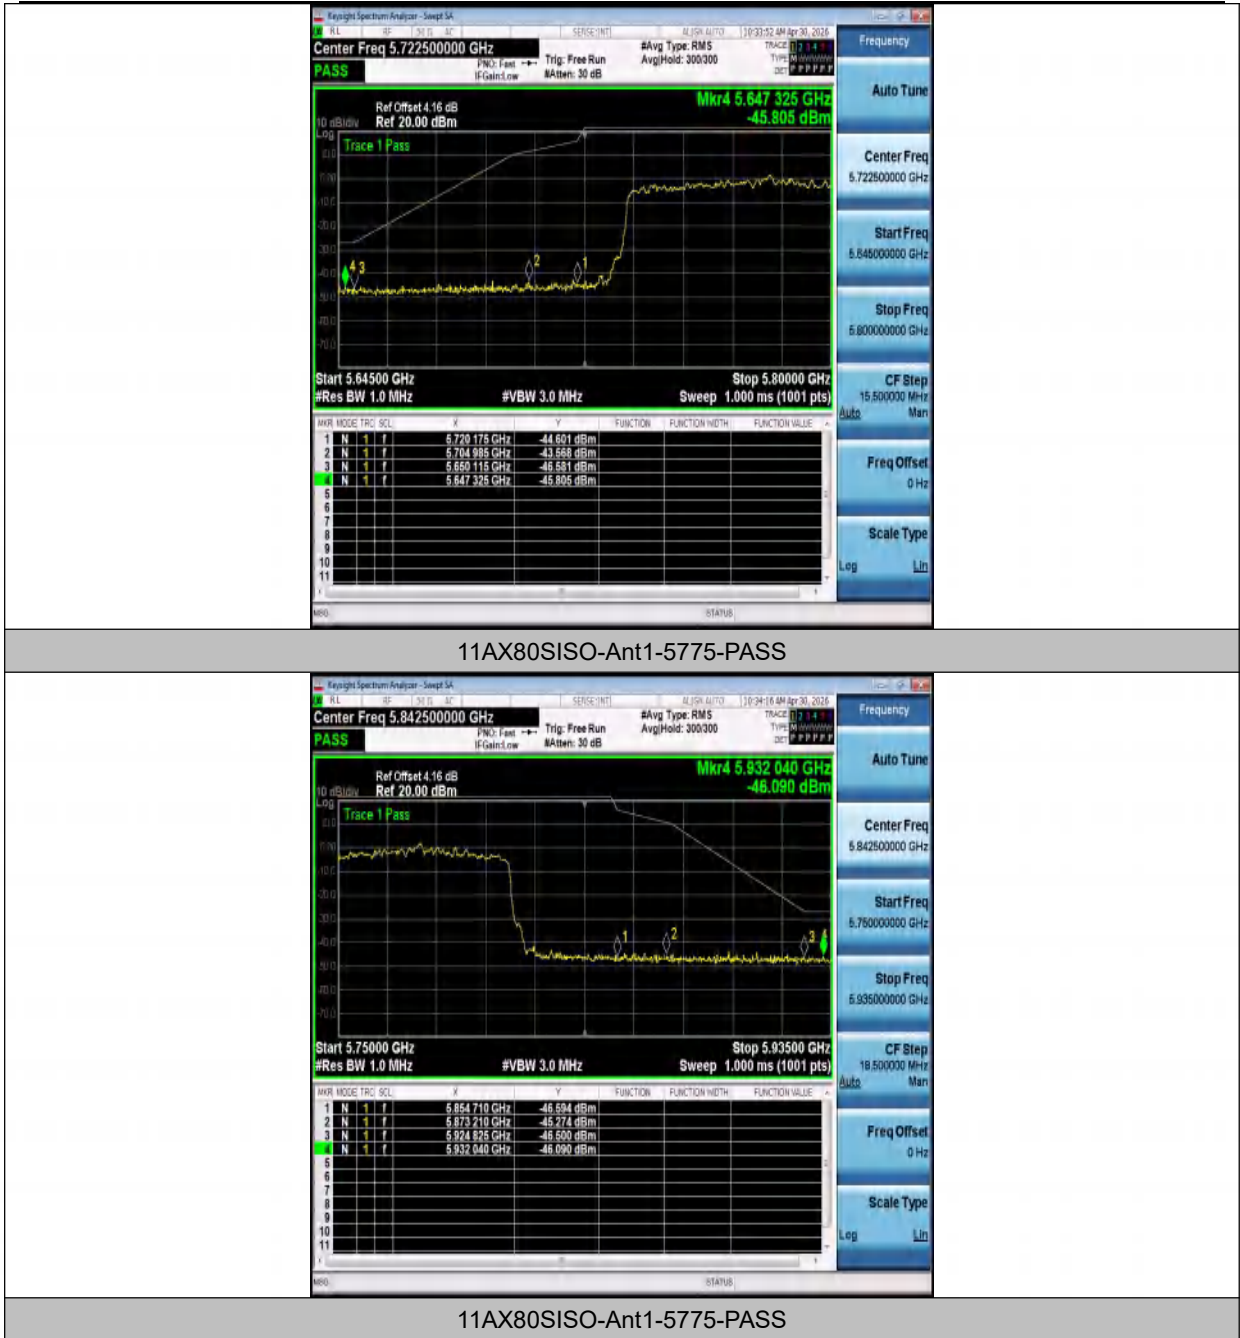

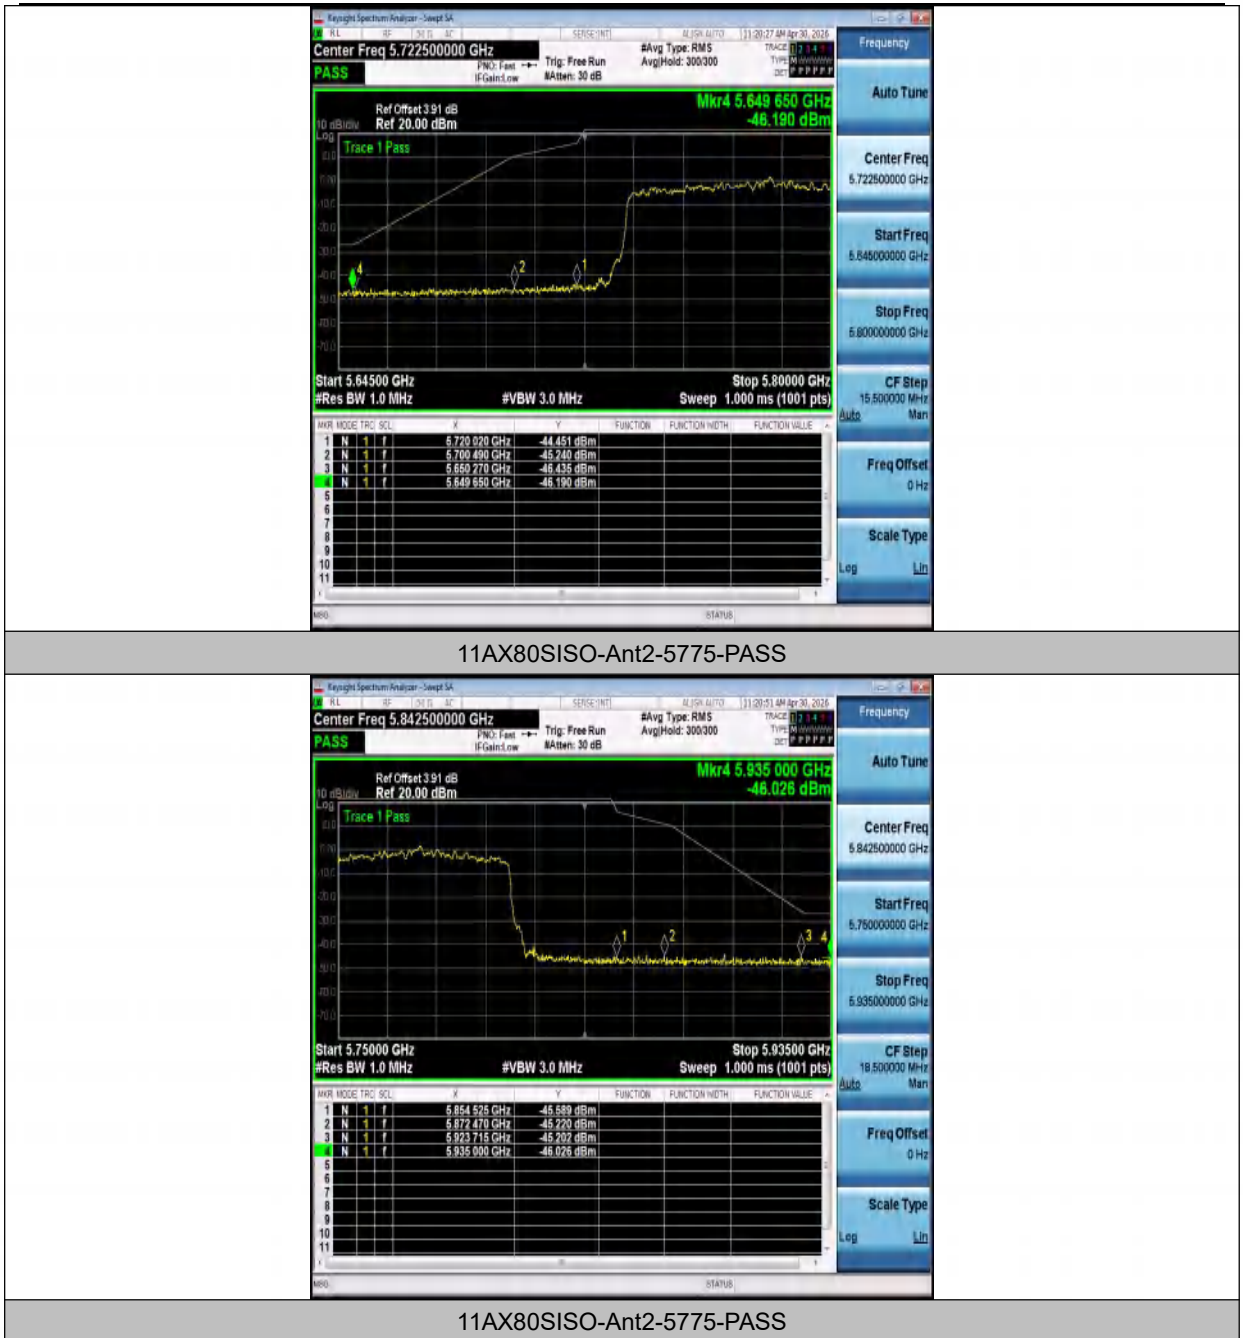

Appendix F: DFS Detection Thresholds


Test Result

TestMode	Frequency[dbm]	Radar Type	Result	Limit[dbm]	Verdict
11AX80SISO	5290	Type0	-62.15	-62.00	PASS
11AX80SISO	5530	Type0	-62.08	-62.00	PASS

Note:

1. The antenna gain is grater than 1.64dBi for WiFi 5.3G, 2.16dBi for WiFi 5.6G, the experiment employed a harsher approach.
2. During the test, pre-scan all modes, the report only record the worse case(ANT2) mode.

Test Graphs

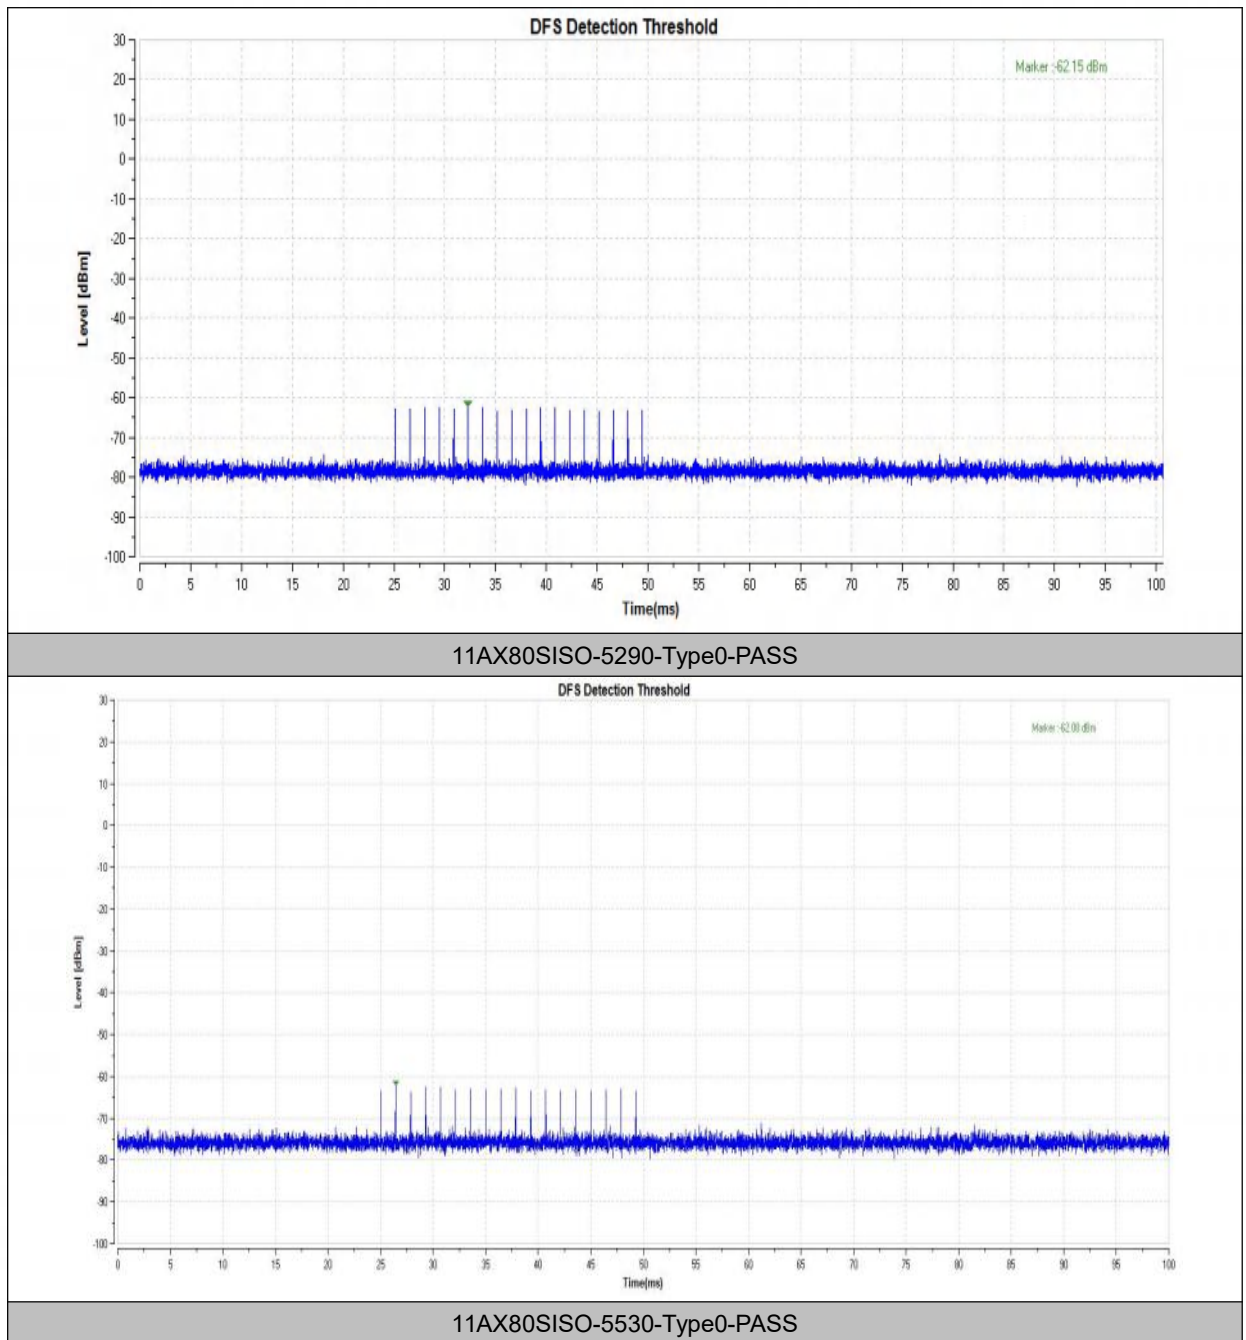

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix G: Channel Move Time and Channel Closing


Transmission Time

Test Result

TestMode	Frequency[MHz]	CCTT[ms]	Limit[ms]	CMT[ms]	Limit[ms]	Verdict
11AX80SISO	5290	200+1.3	200+60	282	10000	PASS
11AX80SISO	5530	200+3.9	200+60	467.6	10000	PASS

Note: During the test, pre-scan all modes, the report only record the worse case(ANT2) mode.

Test Graphs

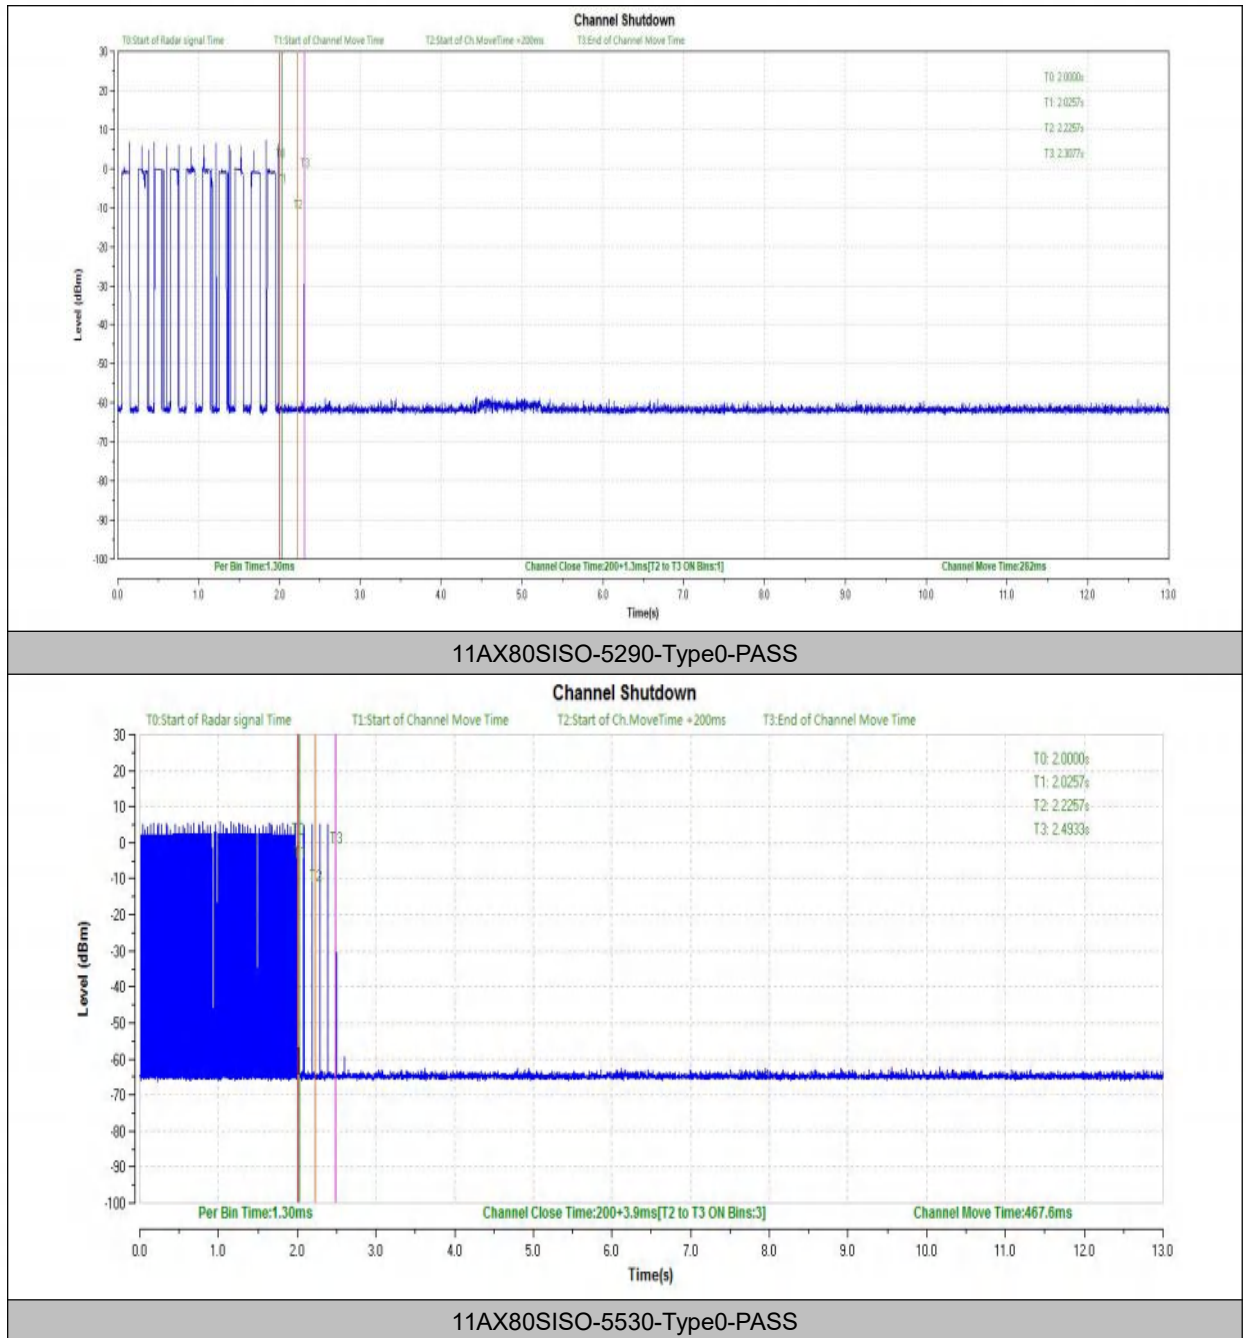

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Appendix H: Non-Occupancy Period

Test Result

TestMode	Frequency[MHz]	Result	Limit[s]	Verdict
11AX80SISO	5290	see test graph	≥1800	PASS
11AX80SISO	5530	see test graph	≥1800	PASS

Note: During the test, pre-scan all modes, the report only record the worse case(ANT2) mode.

Test Graphs

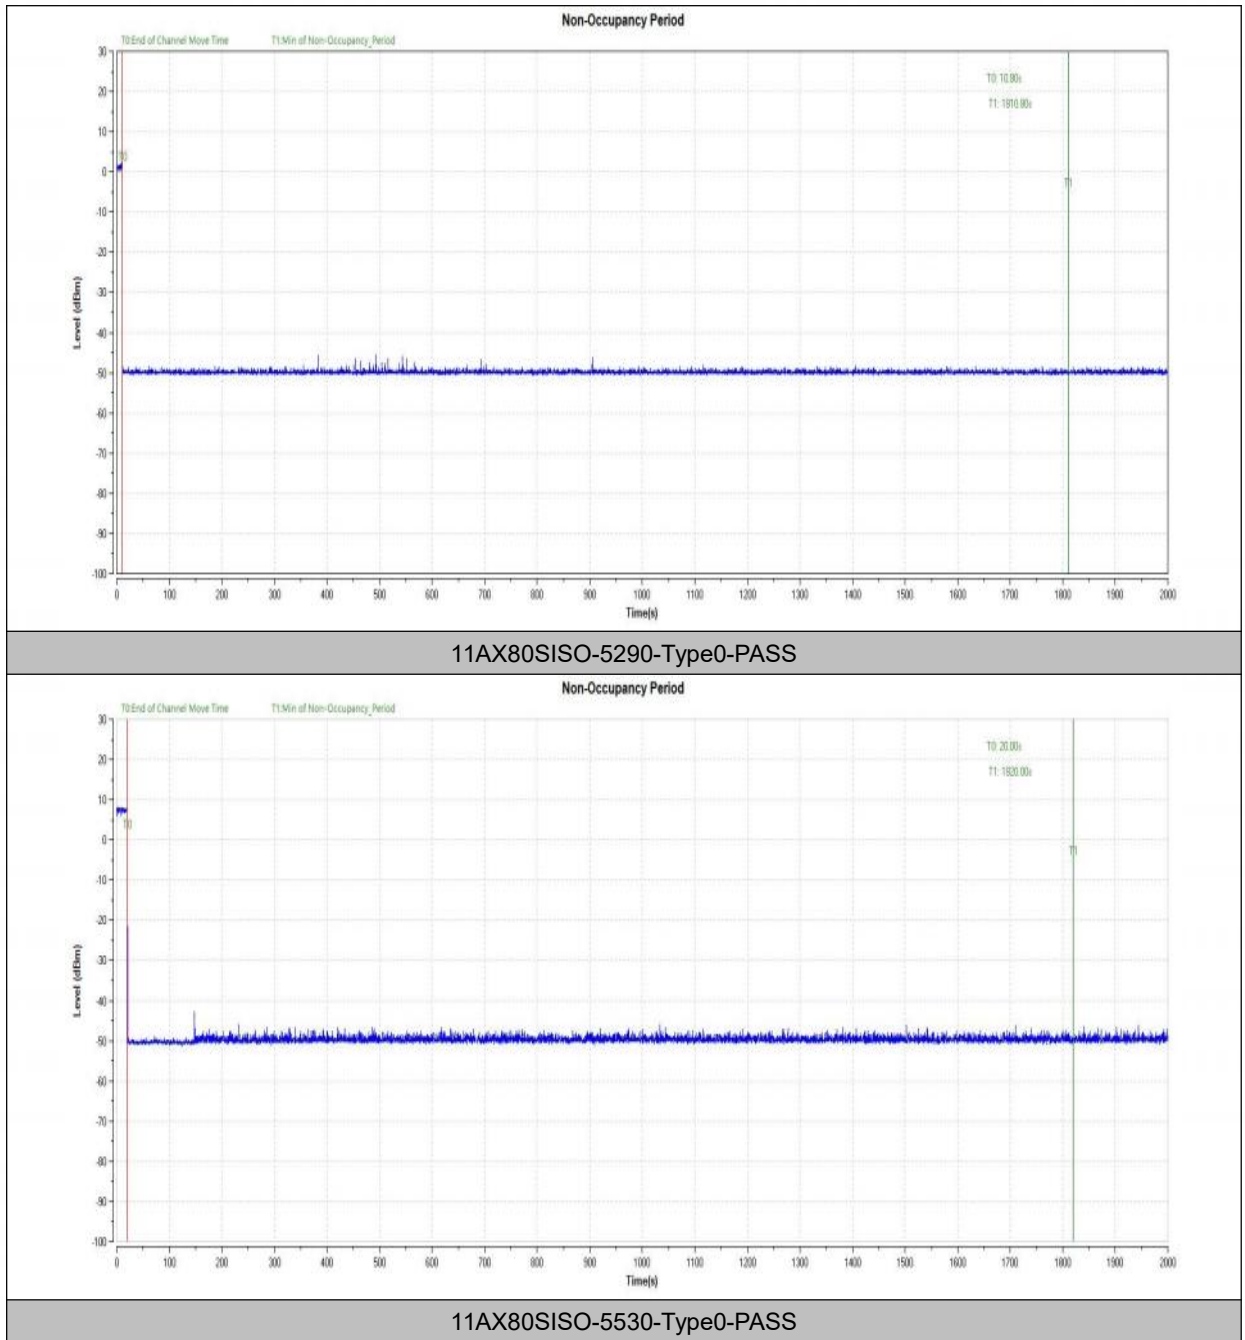

---END---