





Tx. Spurious NVNT 2-DH5 2480MHz Ant1 Ref

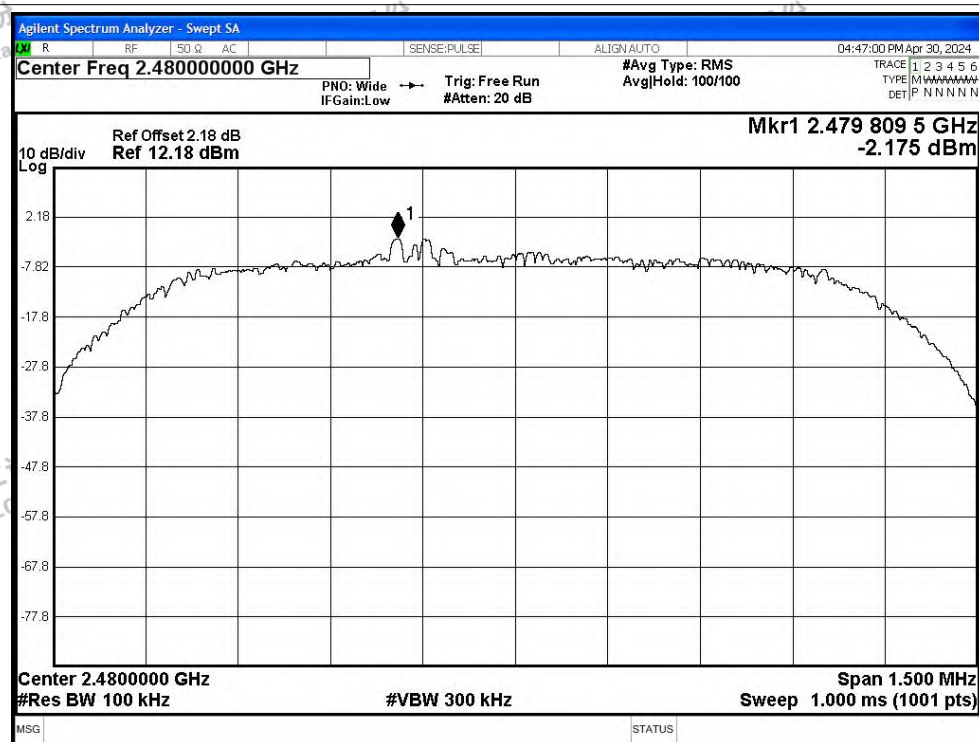

Tx. Spurious NVNT 2-DH5 2480MHz Ant1 Emission

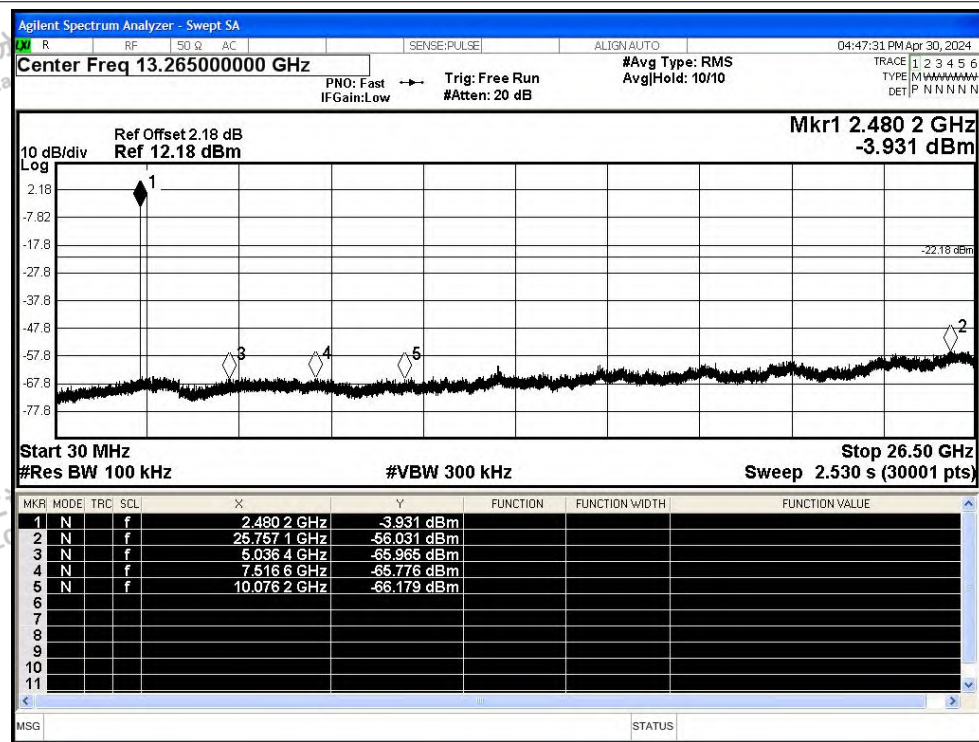

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Tx. Spurious NVNT 3-DH5 2402MHz Ant1 Ref

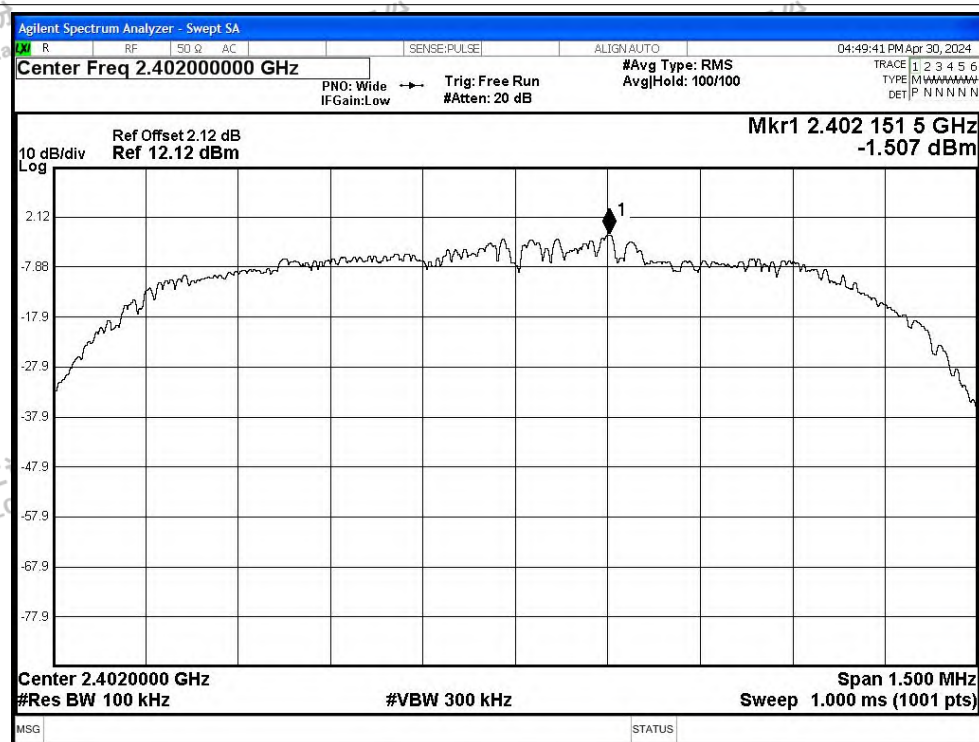

Tx. Spurious NVNT 3-DH5 2402MHz Ant1 Emission

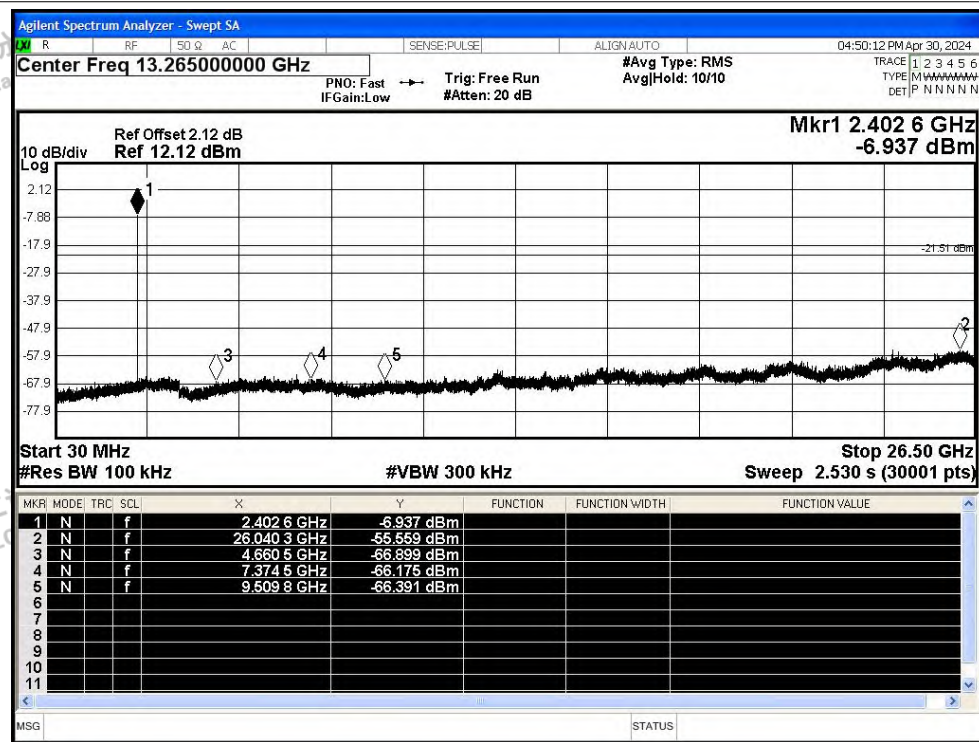

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Tx. Spurious NVNT 3-DH5 2441MHz Ant1 Ref

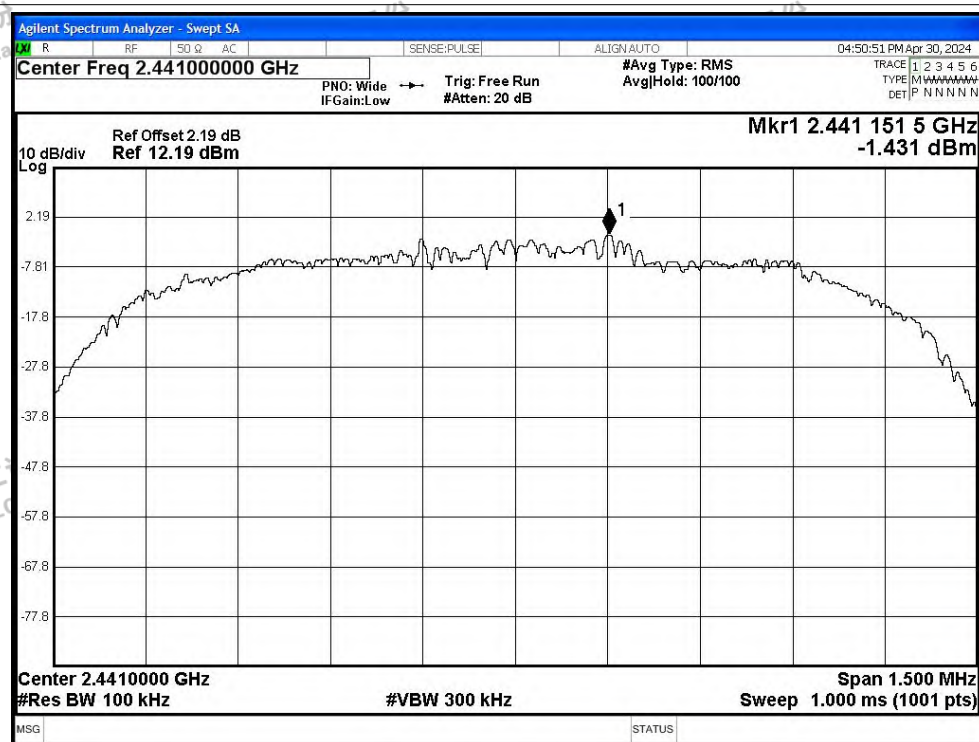

Tx. Spurious NVNT 3-DH5 2441MHz Ant1 Emission

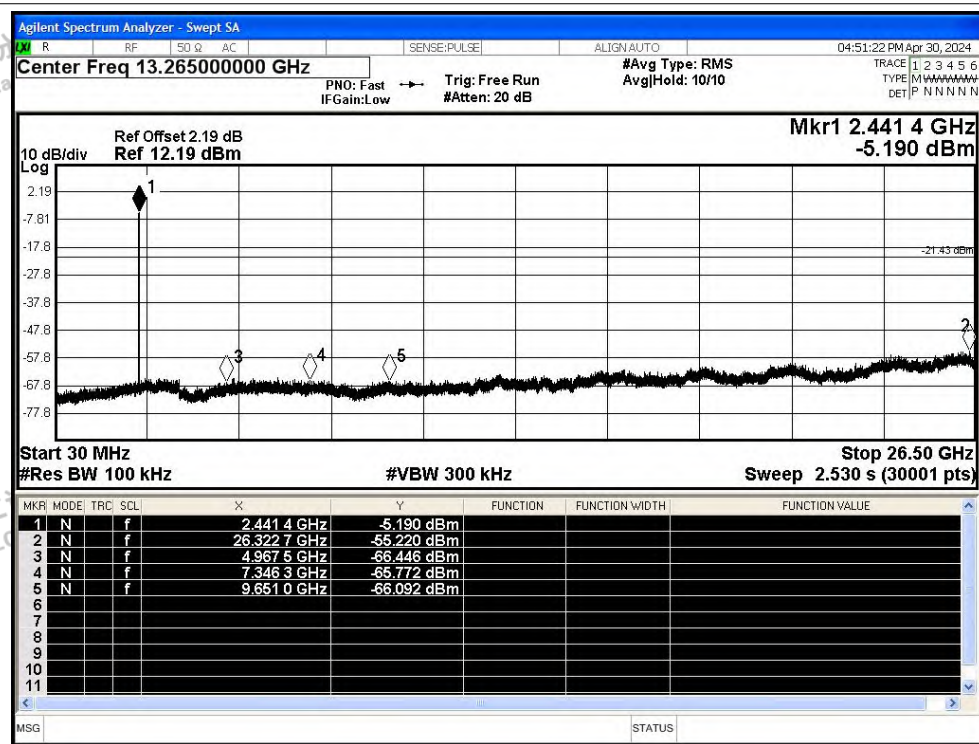

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Tx. Spurious NVNT 3-DH5 2480MHz Ant1 Ref

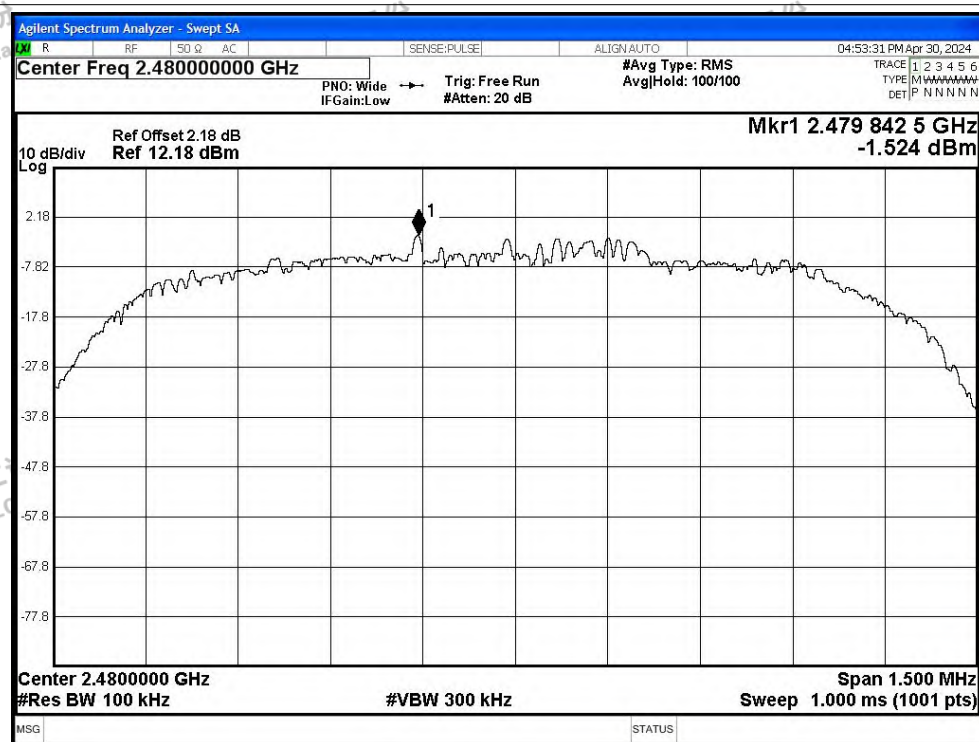

Tx. Spurious NVNT 3-DH5 2480MHz Ant1 Emission

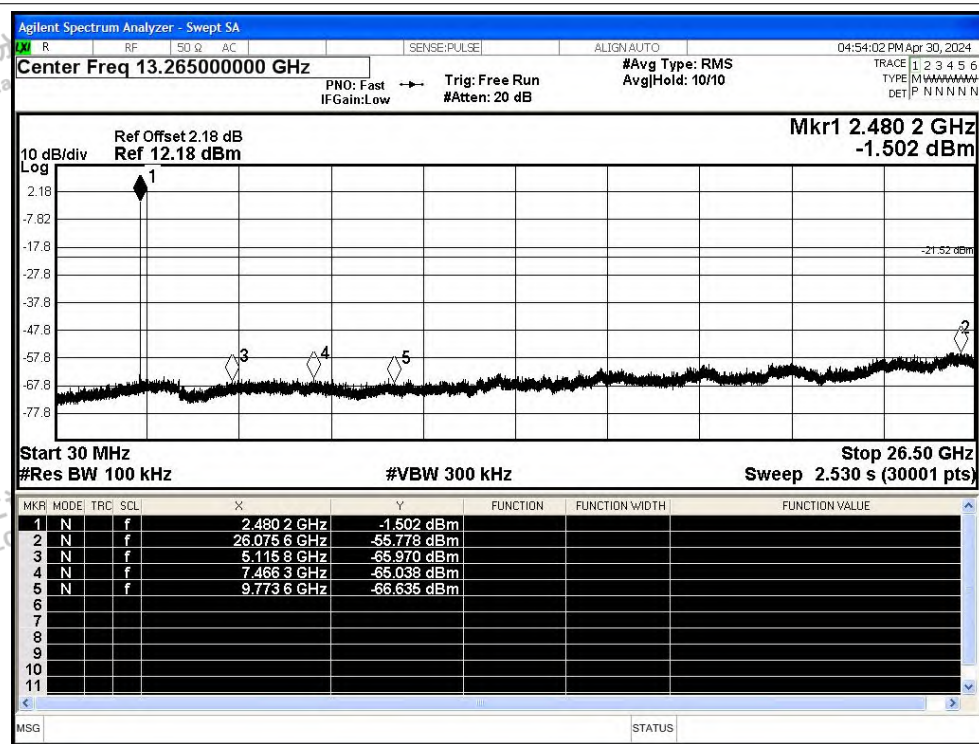

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



A.8 Duty Cycle

Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	1-DH5	2402	Ant1	76.88	1.14	0.35
NVNT	1-DH5	2441	Ant1	76.88	1.14	0.35
NVNT	1-DH5	2480	Ant1	76.88	1.14	0.35
NVNT	2-DH5	2402	Ant1	76.96	1.14	0.35
NVNT	2-DH5	2441	Ant1	76.96	1.14	0.35
NVNT	2-DH5	2480	Ant1	76.98	1.14	0.35
NVNT	3-DH5	2402	Ant1	77.01	1.13	0.35
NVNT	3-DH5	2441	Ant1	77.01	1.13	0.35
NVNT	3-DH5	2480	Ant1	77.01	1.13	0.35




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen,
518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity




Test Graphs

Duty Cycle NVNT 1-DH5 2402MHz Ant1

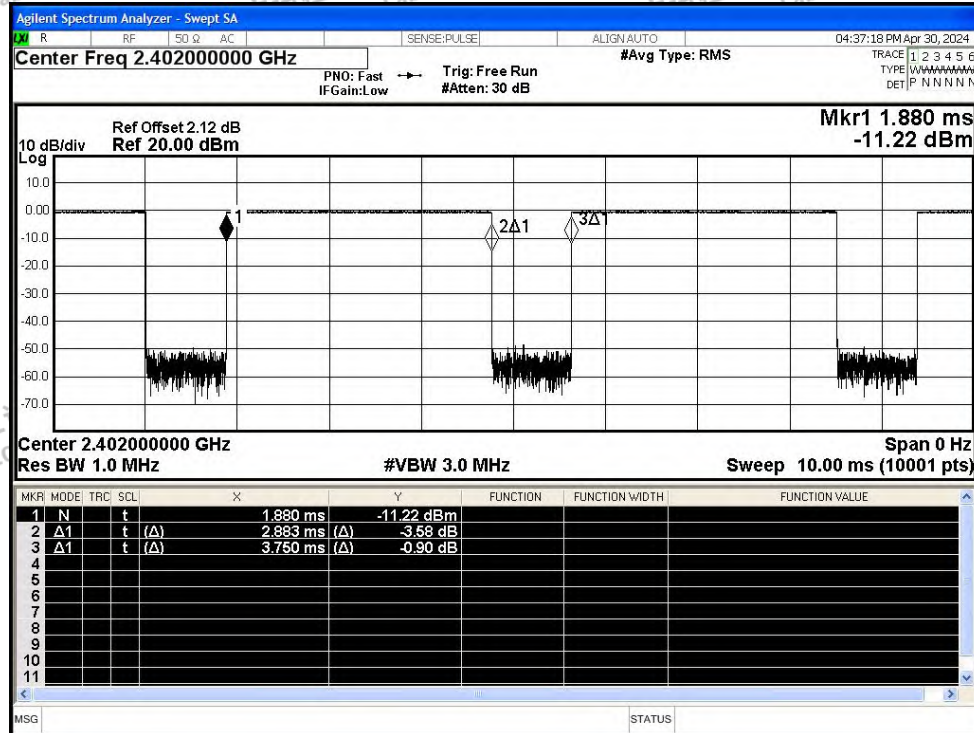

Duty Cycle NVNT 1-DH5 2441MHz Ant1

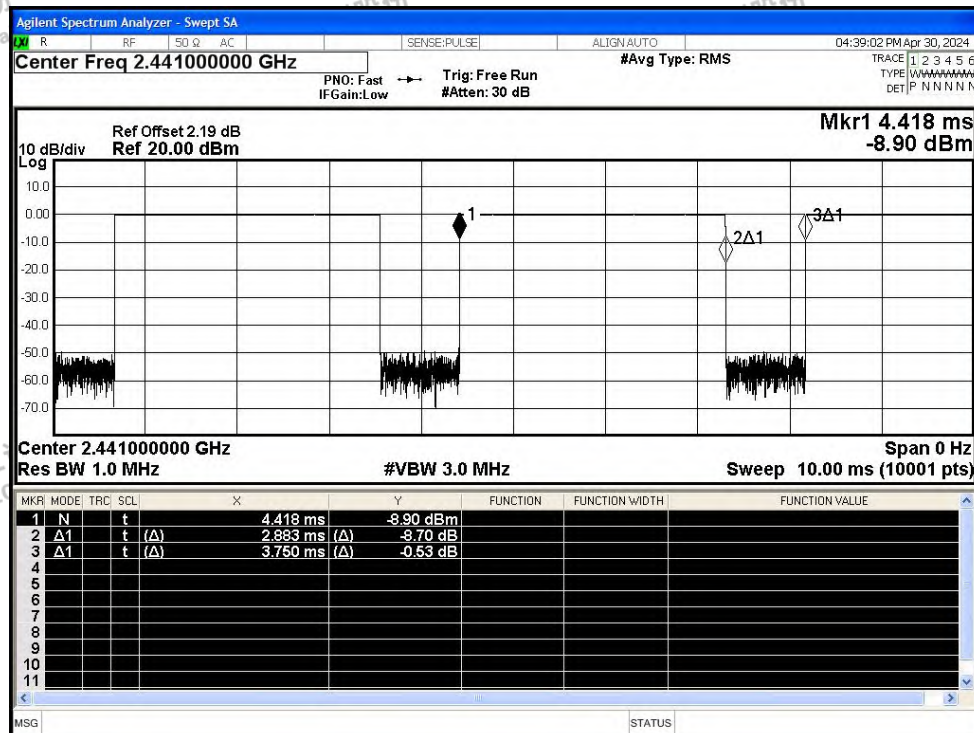

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT 1-DH5 2480MHz Ant1

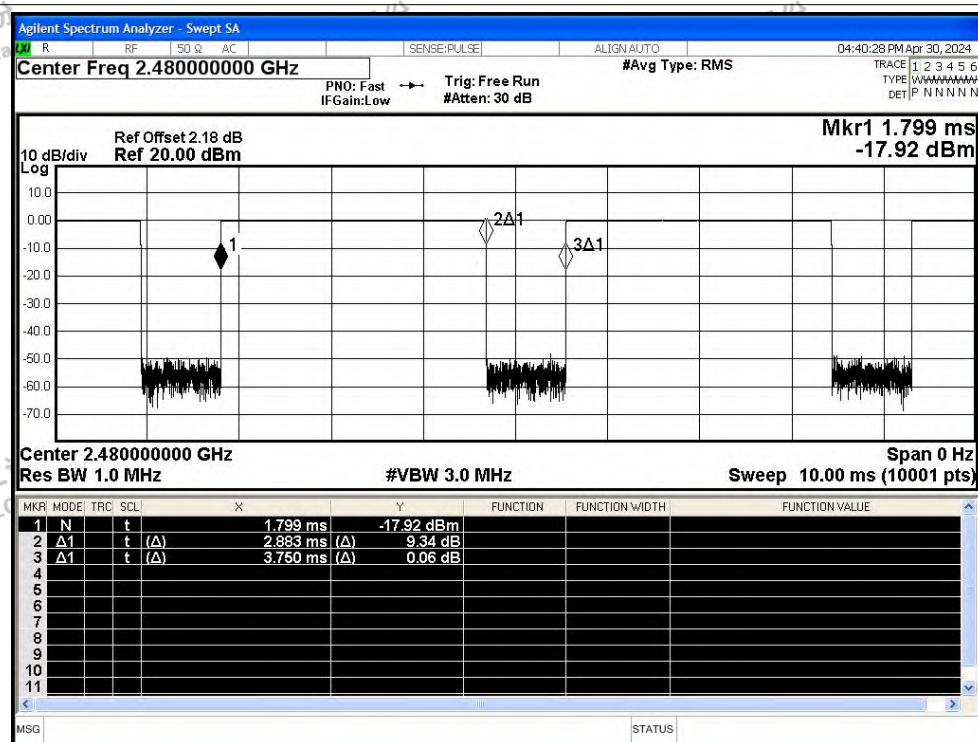

Duty Cycle NVNT 2-DH5 2402MHz Ant1

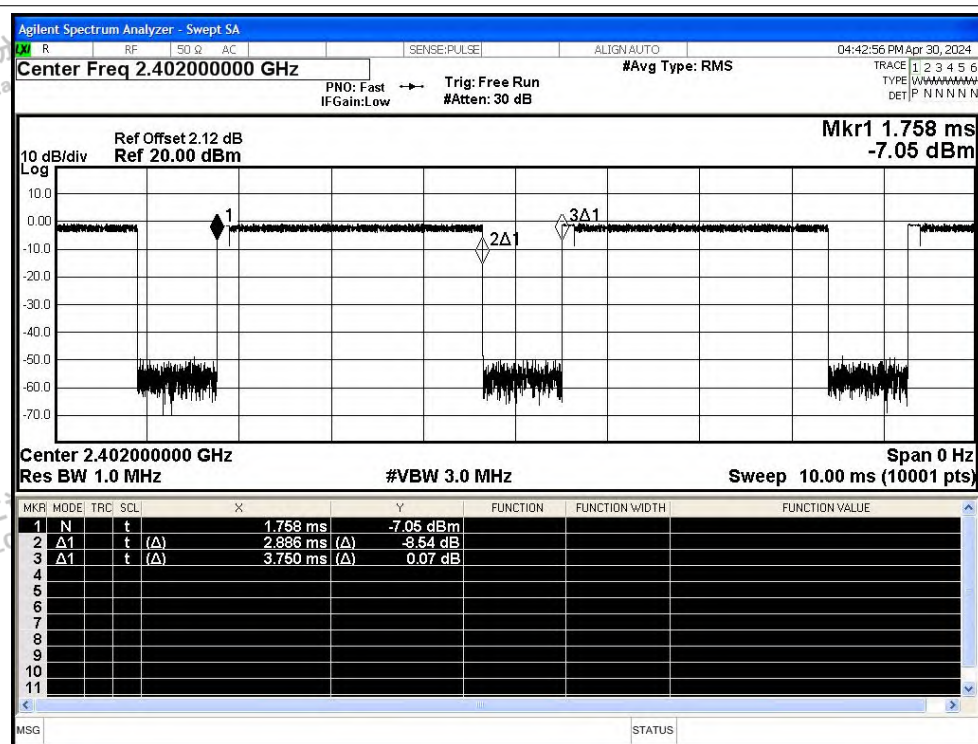

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT 2-DH5 2441MHz Ant1

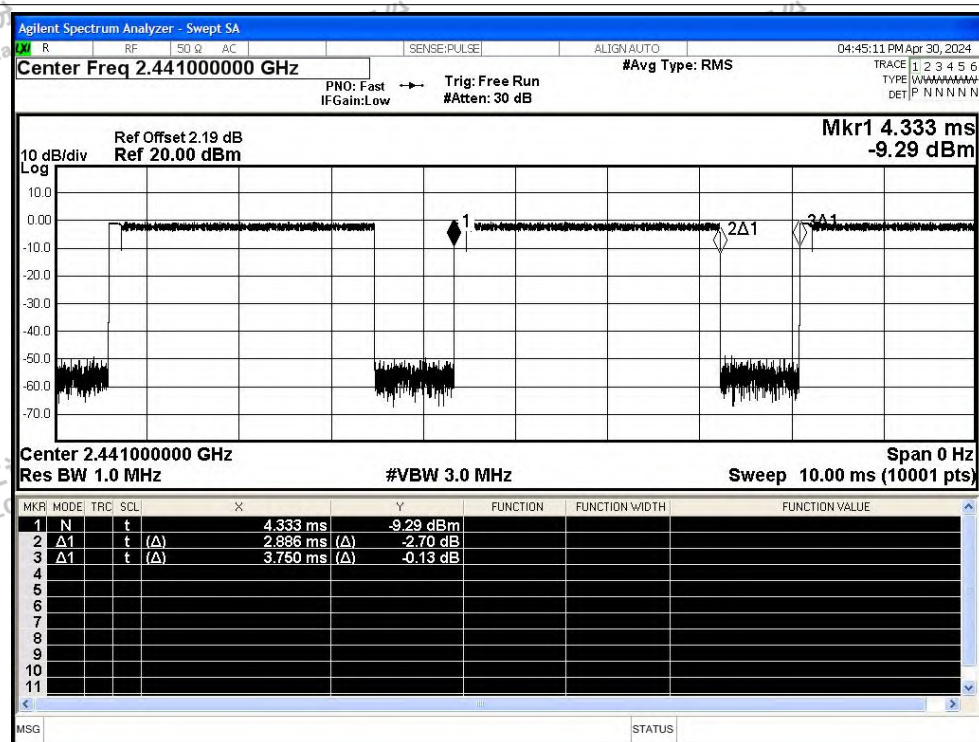

Duty Cycle NVNT 2-DH5 2480MHz Ant1

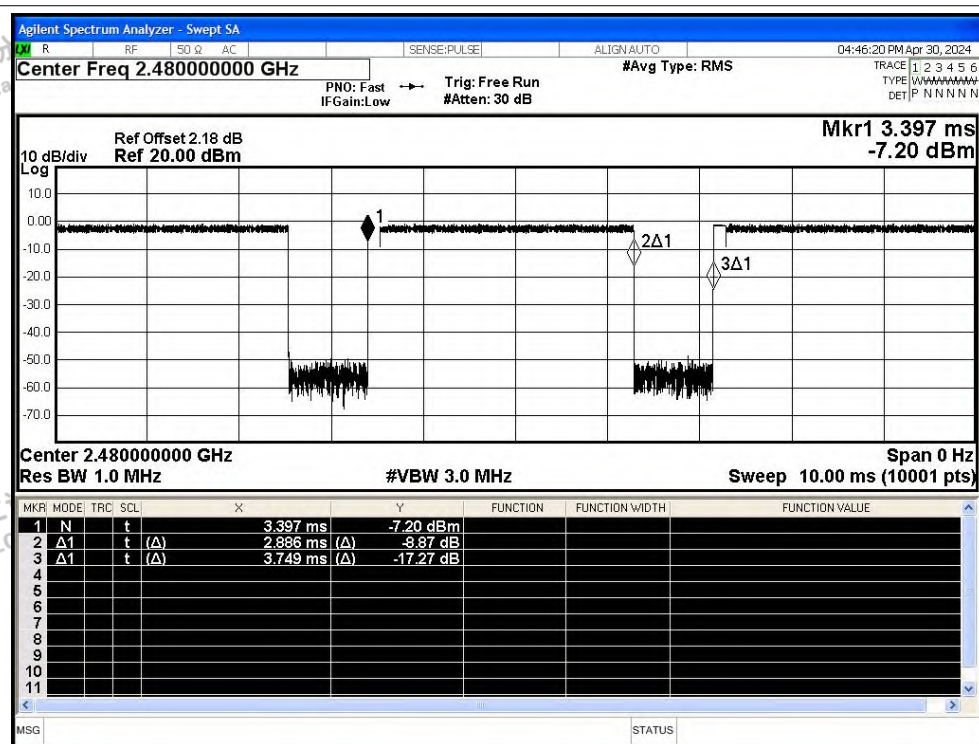

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT 3-DH5 2402MHz Ant1

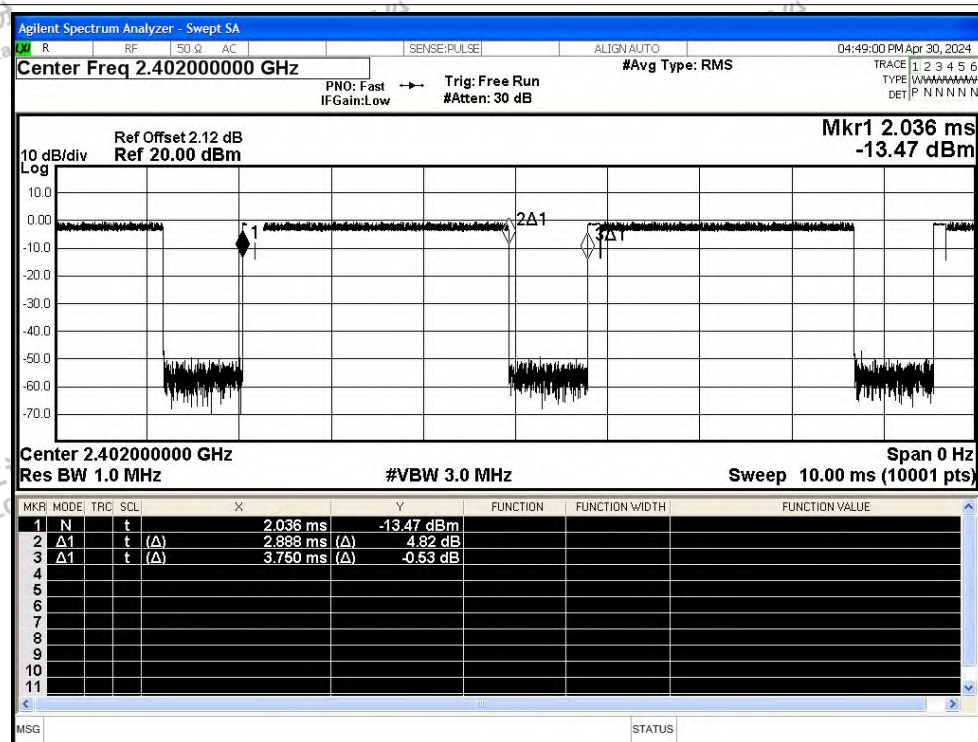

Duty Cycle NVNT 3-DH5 2441MHz Ant1

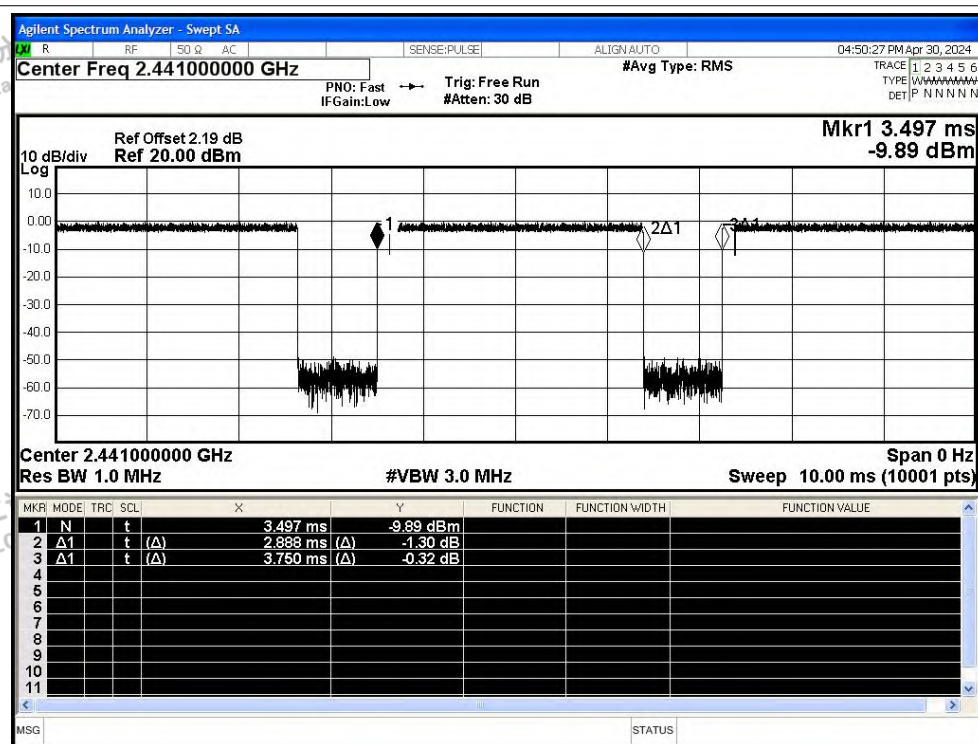


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

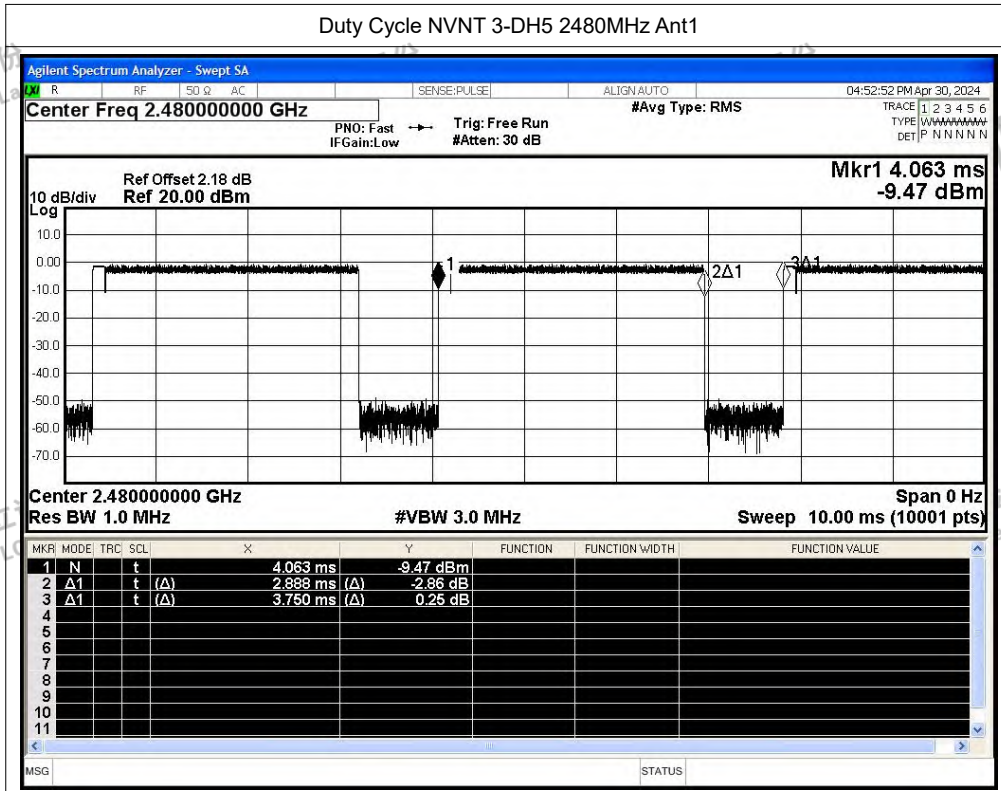



A.9 Restrict Band

Condition	Mode	Frequency (MHz)	Antenna	Hopping Mode	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	1-DH5	2402	Ant1	No-Hopping	2310	-49.1	2	-	48.16	Peak	74	Pass
NVNT	1-DH5	2402	Ant1	No-Hopping	2310	-58.78	2	1.14	39.62	Average	54	Pass
NVNT	1-DH5	2402	Ant1	No-Hopping	2372.688	-46.79	2	-	50.47	Peak	74	Pass
NVNT	1-DH5	2402	Ant1	No-Hopping	2318.64	-57.62	2	1.14	40.78	Average	54	Pass
NVNT	1-DH5	2402	Ant1	No-Hopping	2390	-50.01	2	-	47.25	Peak	74	Pass
NVNT	1-DH5	2402	Ant1	No-Hopping	2390	-58.33	2	1.14	40.07	Average	54	Pass
NVNT	1-DH5	2480	Ant1	No-Hopping	2483.5	-49.21	2	-	48.05	Peak	74	Pass
NVNT	1-DH5	2480	Ant1	No-Hopping	2483.5	-58.34	2	1.14	40.06	Average	54	Pass
NVNT	1-DH5	2480	Ant1	No-Hopping	2487.4	-46.42	2	-	50.84	Peak	74	Pass
NVNT	1-DH5	2480	Ant1	No-Hopping	2494.648	-57.23	2	1.14	41.17	Average	54	Pass
NVNT	1-DH5	2480	Ant1	No-Hopping	2500	-50.68	2	-	46.58	Peak	74	Pass
NVNT	1-DH5	2480	Ant1	No-Hopping	2500	-58.25	2	1.14	40.15	Average	54	Pass
NVNT	2-DH5	2402	Ant1	No-Hopping	2310	-50.61	2	-	46.65	Peak	74	Pass
NVNT	2-DH5	2402	Ant1	No-Hopping	2310	-58.59	2	1.14	39.81	Average	54	Pass
NVNT	2-DH5	2402	Ant1	No-Hopping	2315.088	-47.75	2	-	49.51	Peak	74	Pass
NVNT	2-DH5	2402	Ant1	No-Hopping	2382.768	-57.64	2	1.14	40.76	Average	54	Pass
NVNT	2-DH5	2402	Ant1	No-Hopping	2390	-49.57	2	-	47.69	Peak	74	Pass
NVNT	2-DH5	2402	Ant1	No-Hopping	2390	-58.43	2	1.14	39.97	Average	54	Pass
NVNT	2-DH5	2480	Ant1	No-Hopping	2483.5	-49.61	2	-	47.65	Peak	74	Pass
NVNT	2-DH5	2480	Ant1	No-Hopping	2483.5	-58.31	2	1.14	40.09	Average	54	Pass
NVNT	2-DH5	2480	Ant1	No-Hopping	2495.128	-46.84	2	-	50.42	Peak	74	Pass
NVNT	2-DH5	2480	Ant1	No-Hopping	2490.544	-57.21	2	1.14	41.19	Average	54	Pass
NVNT	2-DH5	2480	Ant1	No-Hopping	2500	-51.09	2	-	46.17	Peak	74	Pass
NVNT	2-DH5	2480	Ant1	No-Hopping	2500	-58.01	2	1.14	40.39	Average	54	Pass
NVNT	3-DH5	2402	Ant1	No-Hopping	2310	-51.61	2	-	45.65	Peak	74	Pass
NVNT	3-DH5	2402	Ant1	No-Hopping	2310	-58.93	2	1.13	39.46	Average	54	Pass
NVNT	3-DH5	2402	Ant1	No-Hopping	2367.408	-47.16	2	-	50.1	Peak	74	Pass
NVNT	3-DH5	2402	Ant1	No-Hopping	2348.496	-57.8	2	1.13	40.59	Average	54	Pass
NVNT	3-DH5	2402	Ant1	No-Hopping	2390	-50.42	2	-	46.84	Peak	74	Pass
NVNT	3-DH5	2402	Ant1	No-Hopping	2390	-58.75	2	1.13	39.64	Average	54	Pass
NVNT	3-DH5	2480	Ant1	No-Hopping	2483.5	-49	2	-	48.26	Peak	74	Pass
NVNT	3-DH5	2480	Ant1	No-Hopping	2483.5	-58.12	2	1.13	40.27	Average	54	Pass
NVNT	3-DH5	2480	Ant1	No-Hopping	2487.184	-47.24	2	-	50.02	Peak	74	Pass
NVNT	3-DH5	2480	Ant1	No-Hopping	2499.232	-57.16	2	1.13	41.23	Average	54	Pass
NVNT	3-DH5	2480	Ant1	No-Hopping	2500	-51.05	2	-	46.21	Peak	74	Pass
NVNT	3-DH5	2480	Ant1	No-Hopping	2500	-57.91	2	1.13	40.48	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Restrict Band NVNT 1-DH5 2402MHz Ant1 No-Hopping Peak

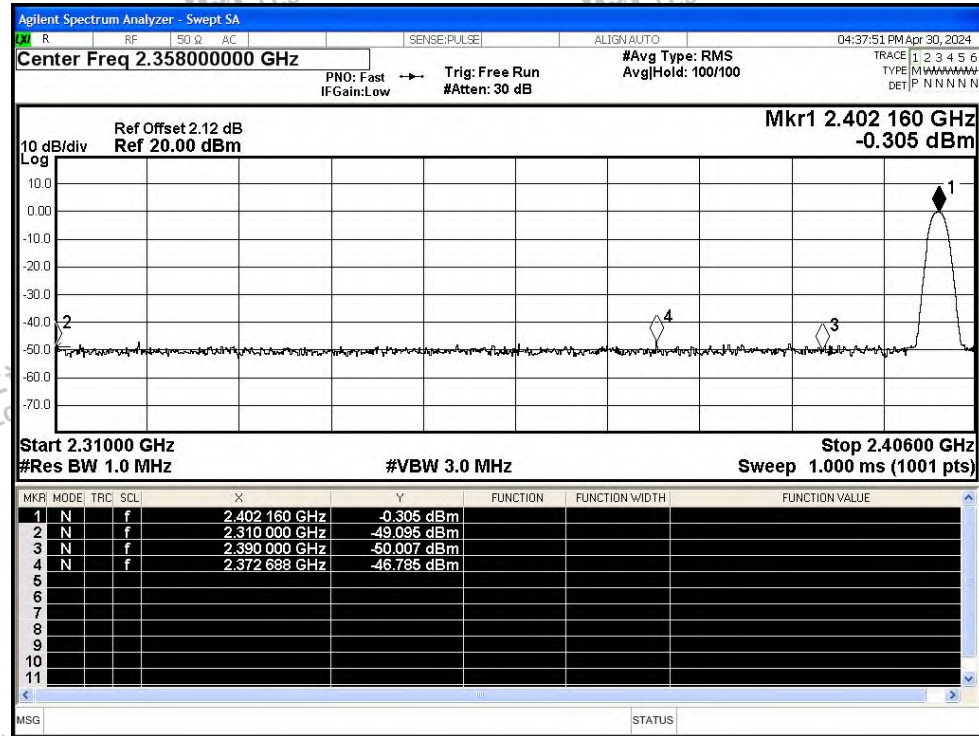

Restrict Band NVNT 1-DH5 2402MHz Ant1 No-Hopping Average

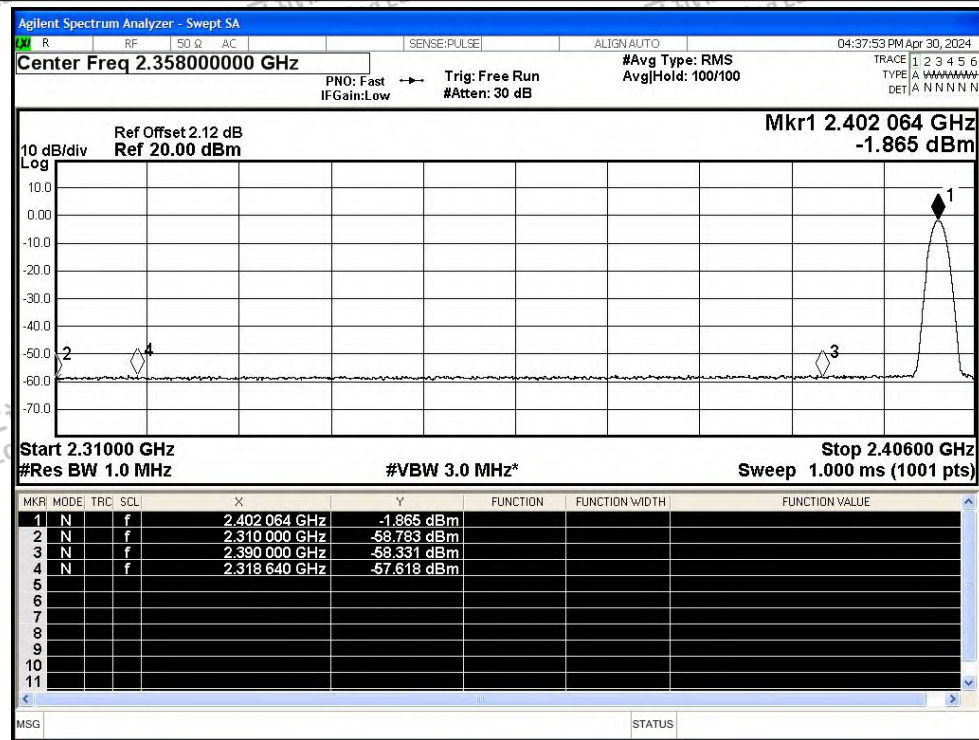

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT 1-DH5 2480MHz Ant1 No-Hopping Peak

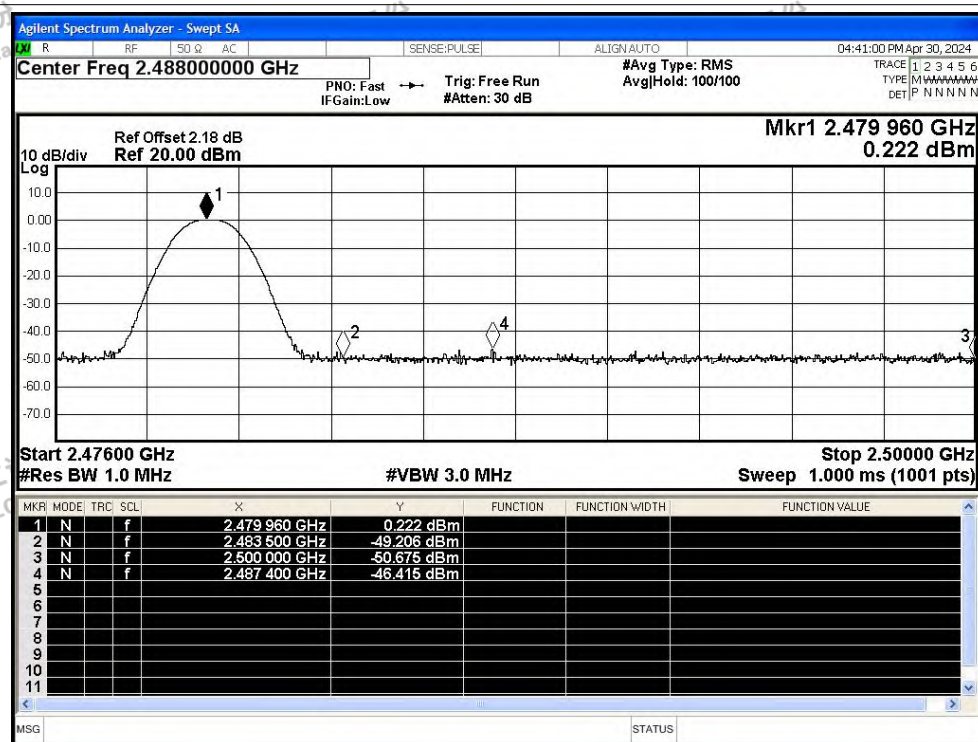

Restrict Band NVNT 1-DH5 2480MHz Ant1 No-Hopping Average


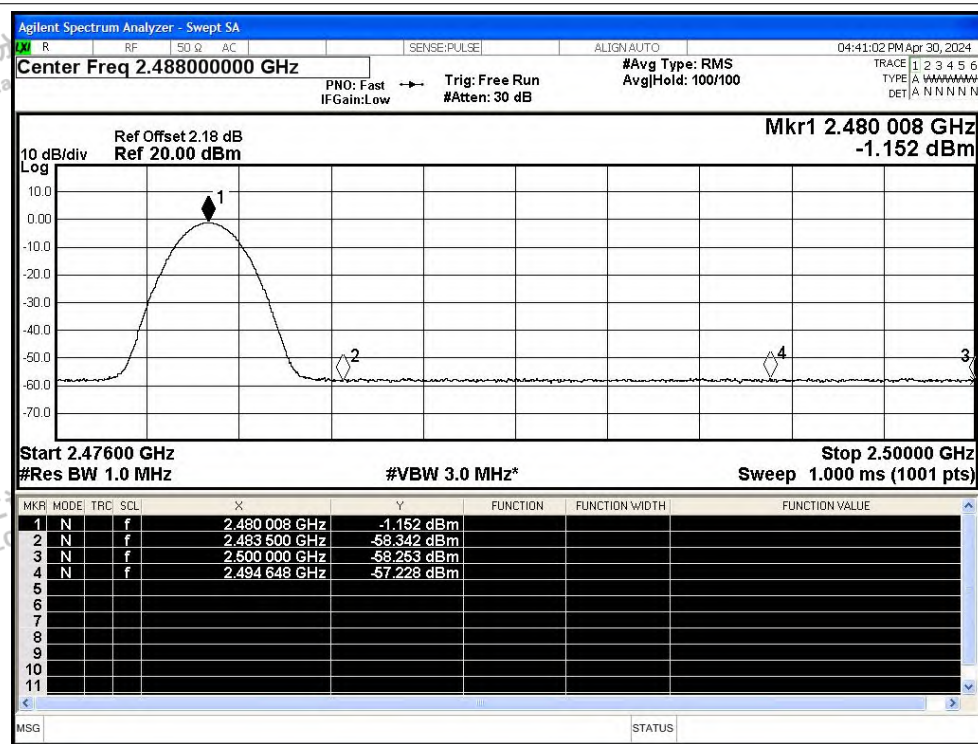


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

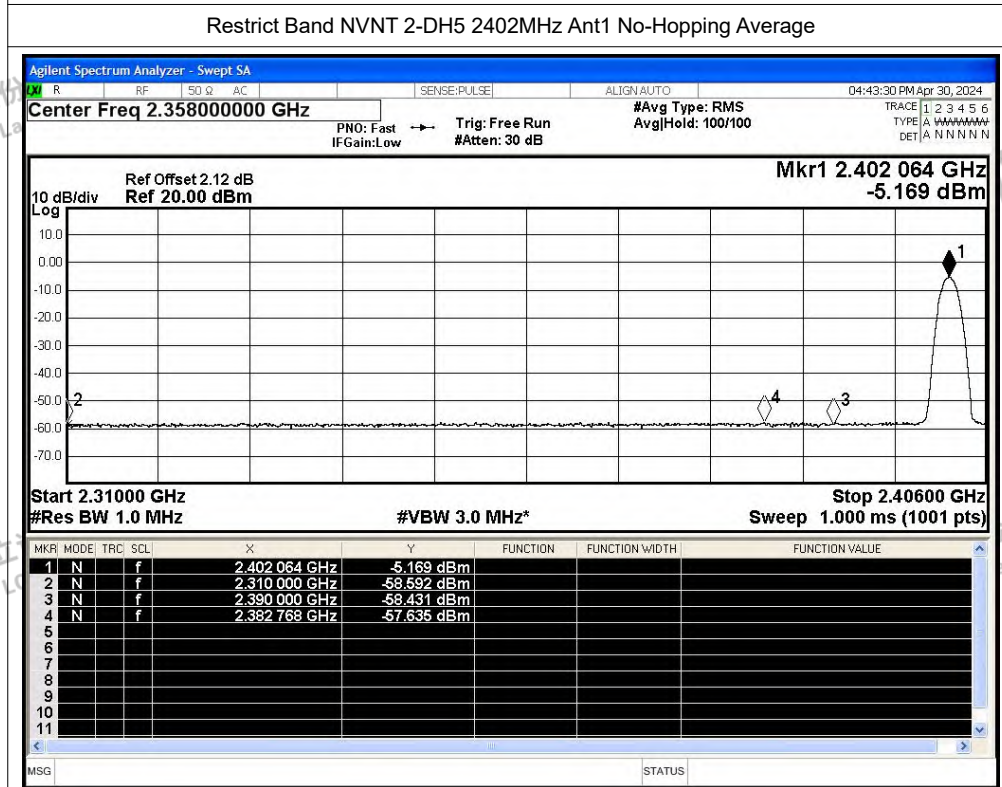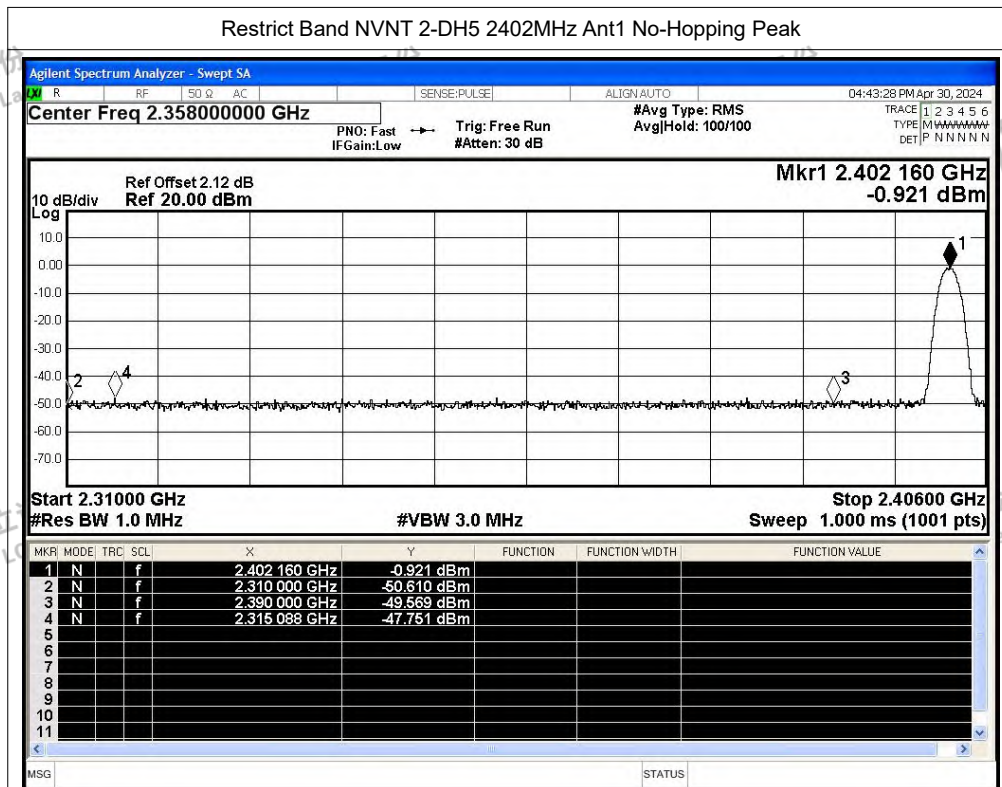

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT 2-DH5 2480MHz Ant1 No-Hopping Peak

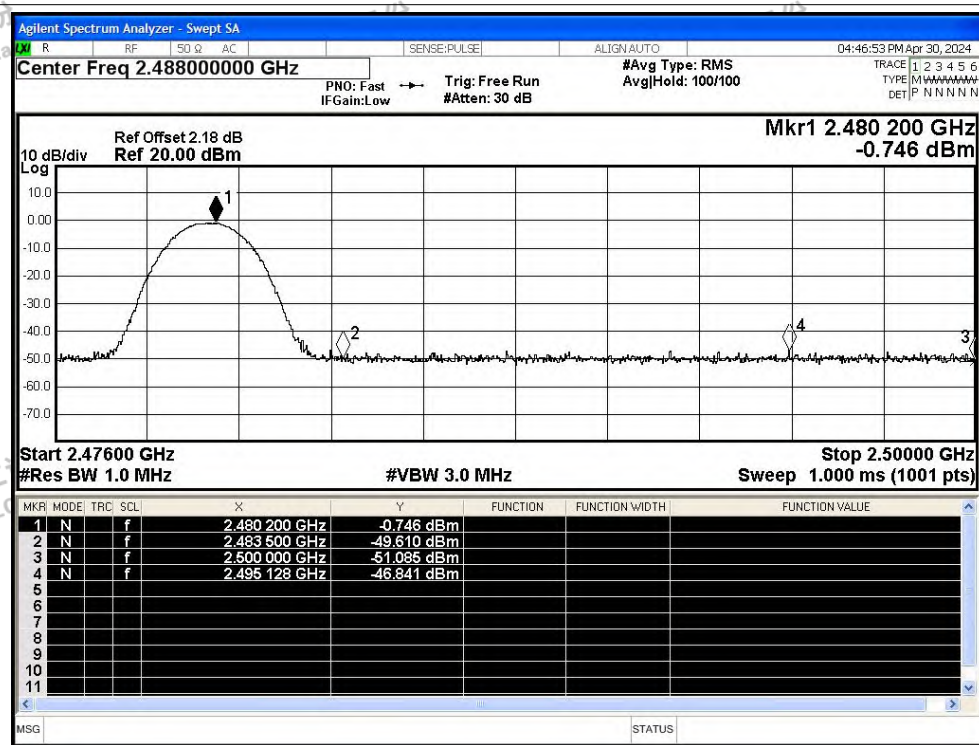

Restrict Band NVNT 2-DH5 2480MHz Ant1 No-Hopping Average

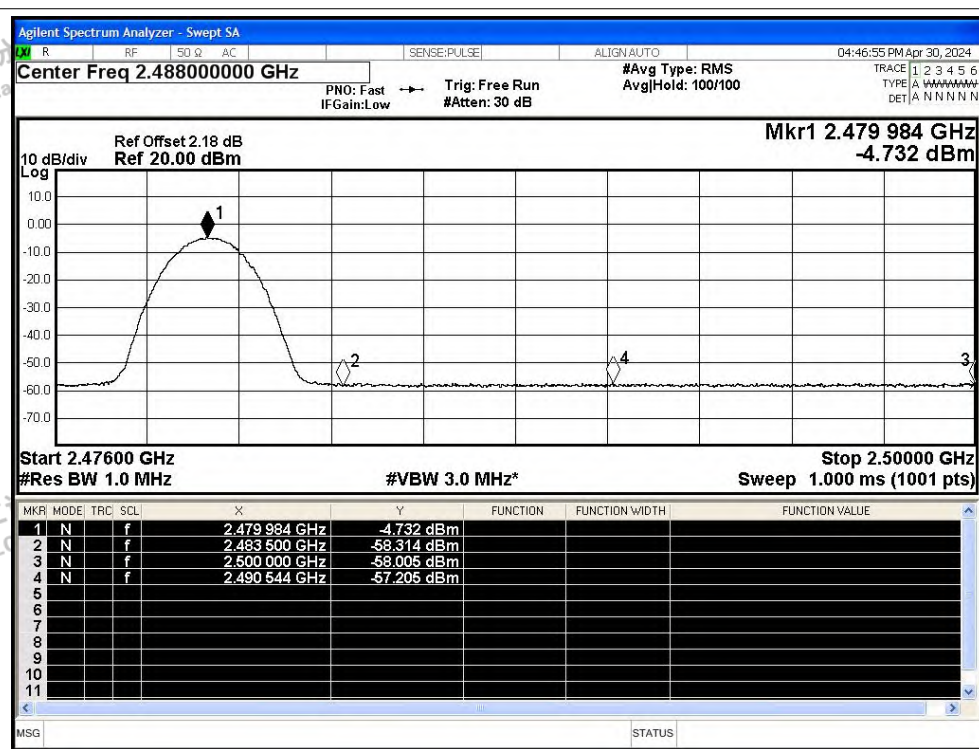

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT 3-DH5 2402MHz Ant1 No-Hopping Peak

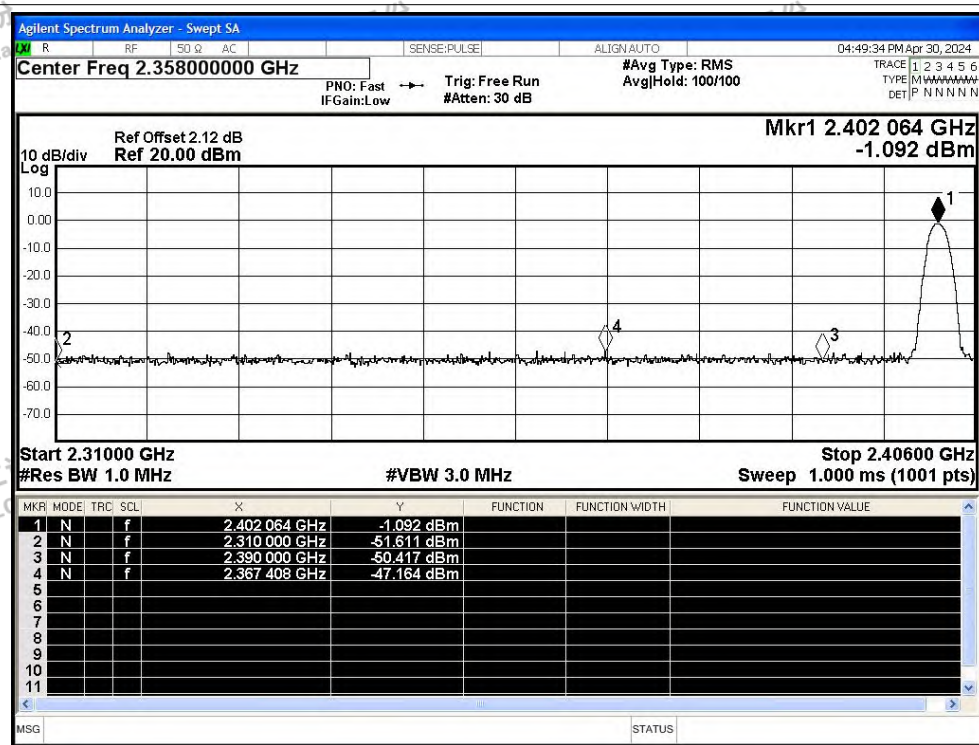

Restrict Band NVNT 3-DH5 2402MHz Ant1 No-Hopping Average

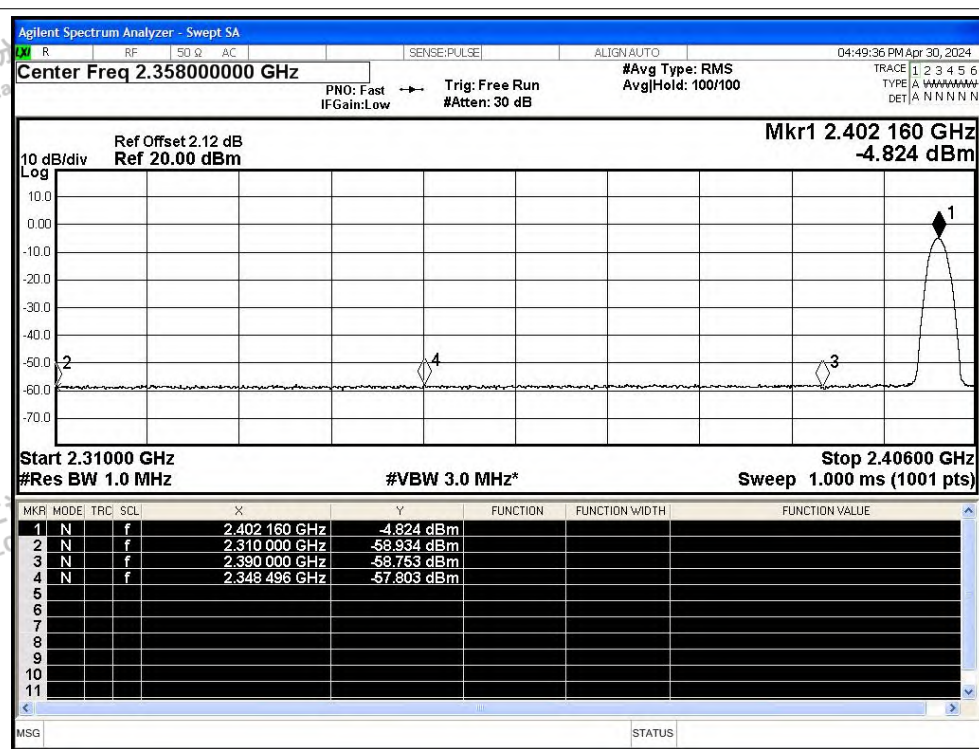

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT 3-DH5 2480MHz Ant1 No-Hopping Peak

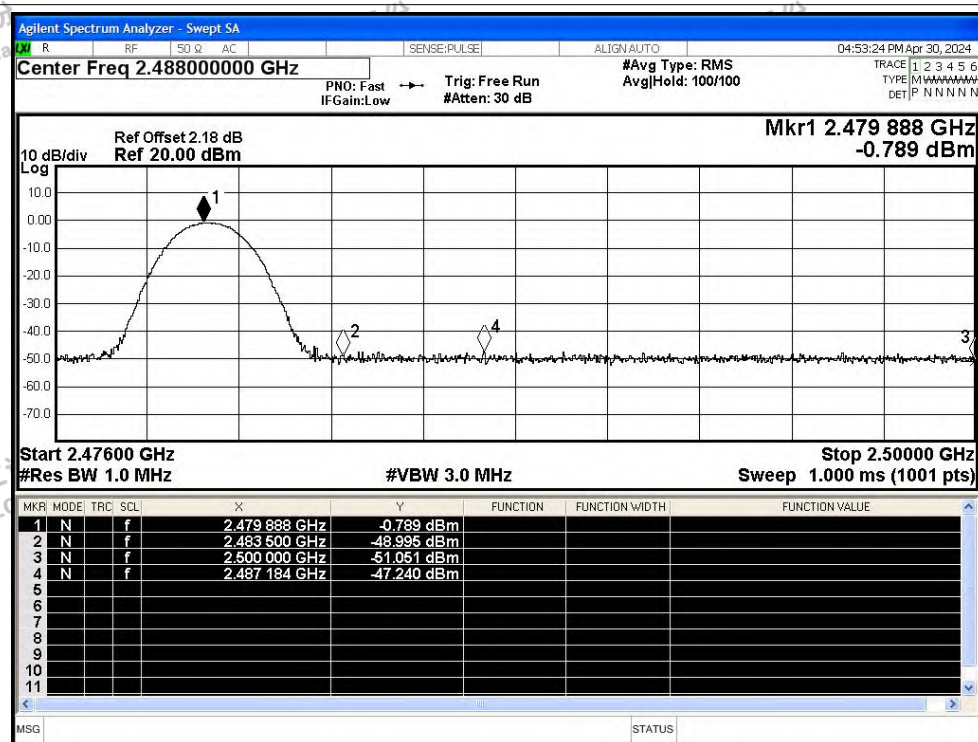

Restrict Band NVNT 3-DH5 2480MHz Ant1 No-Hopping Average

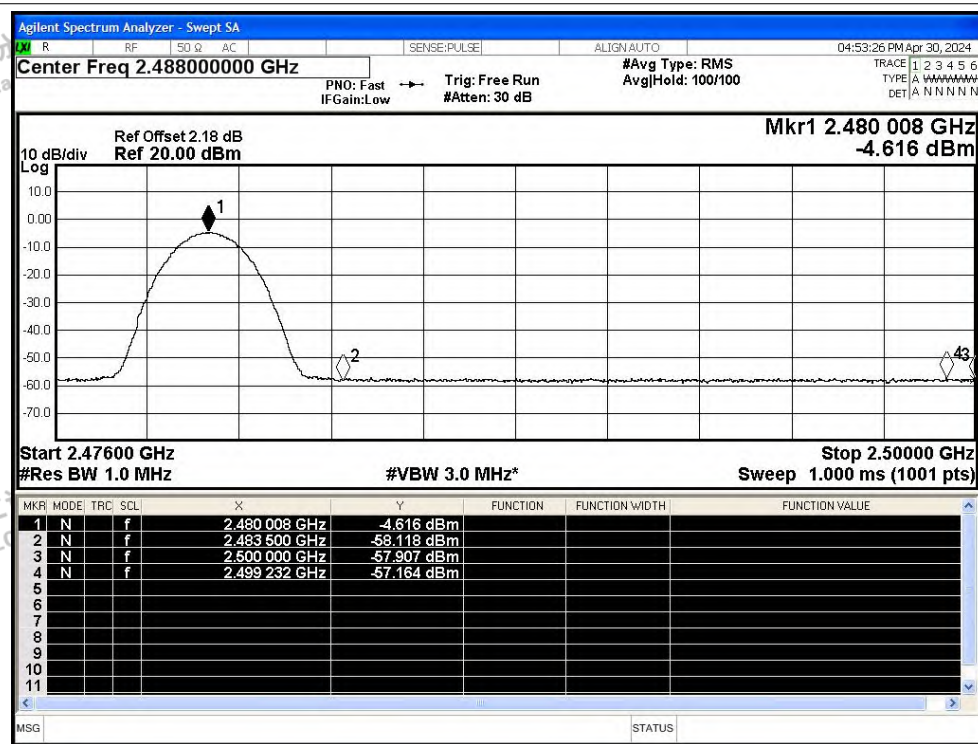

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity