




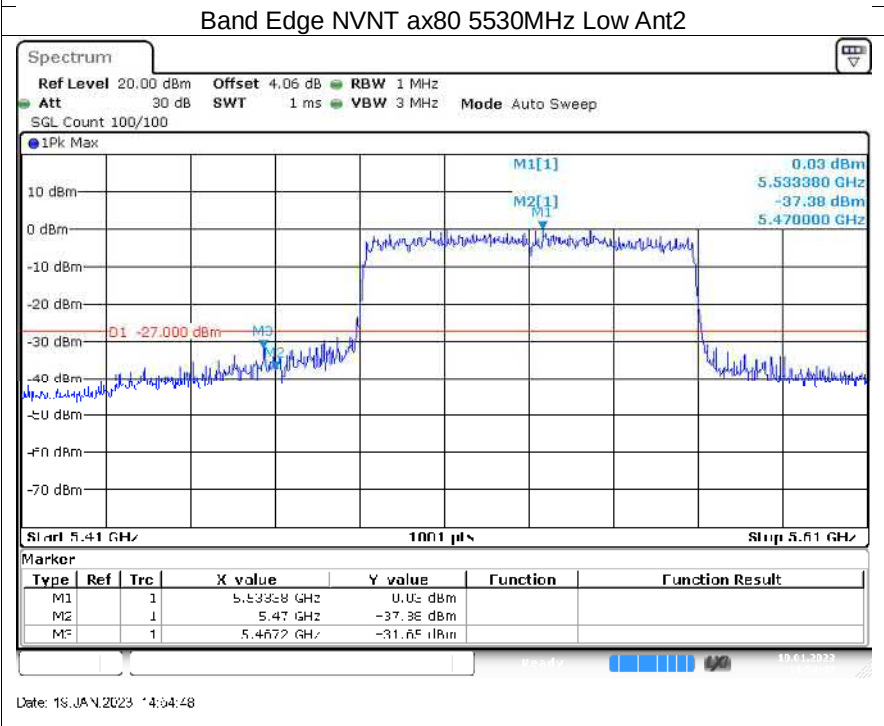
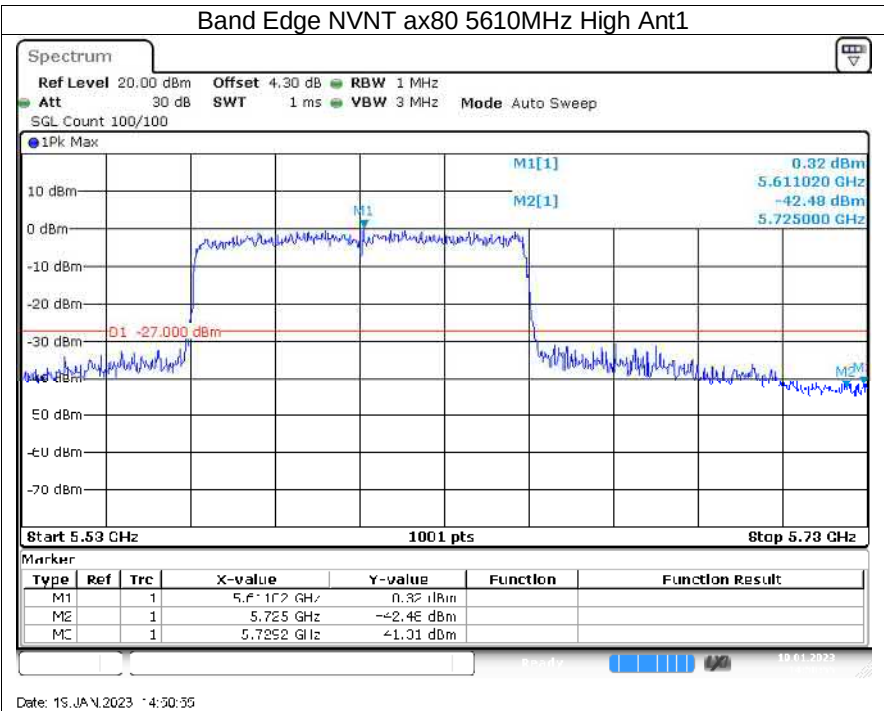
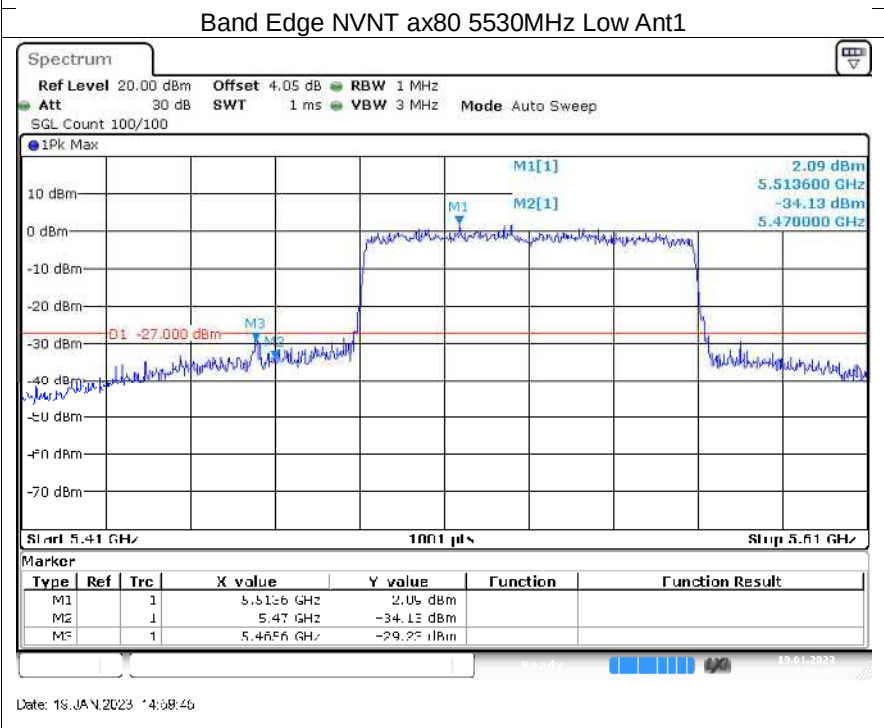


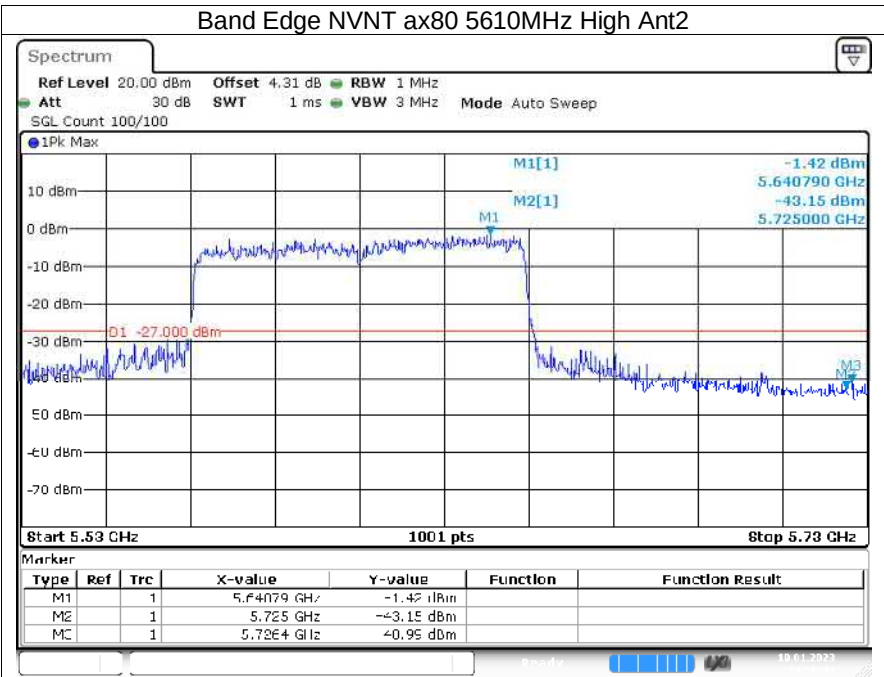


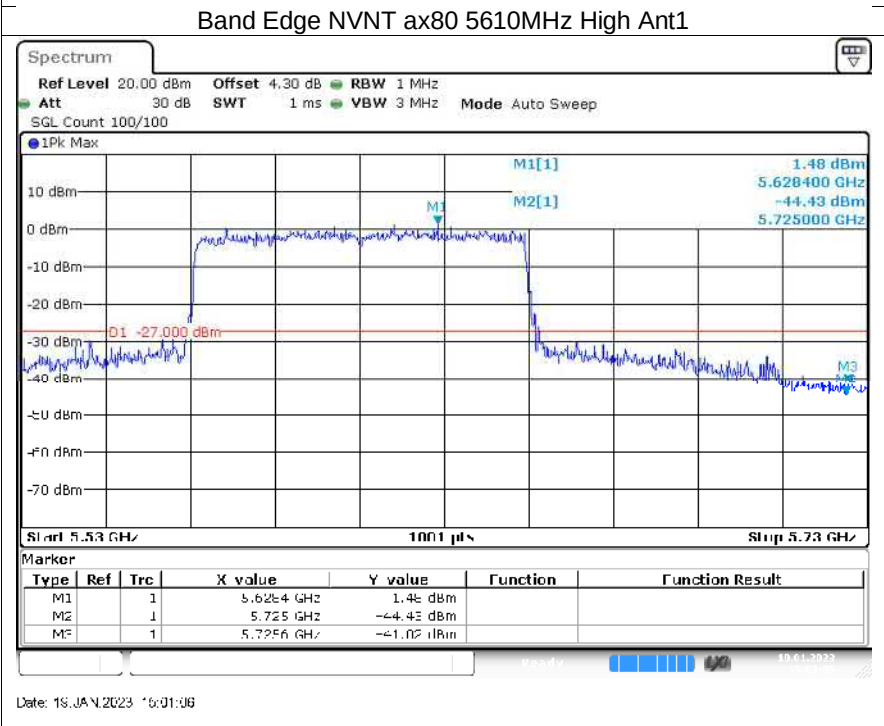


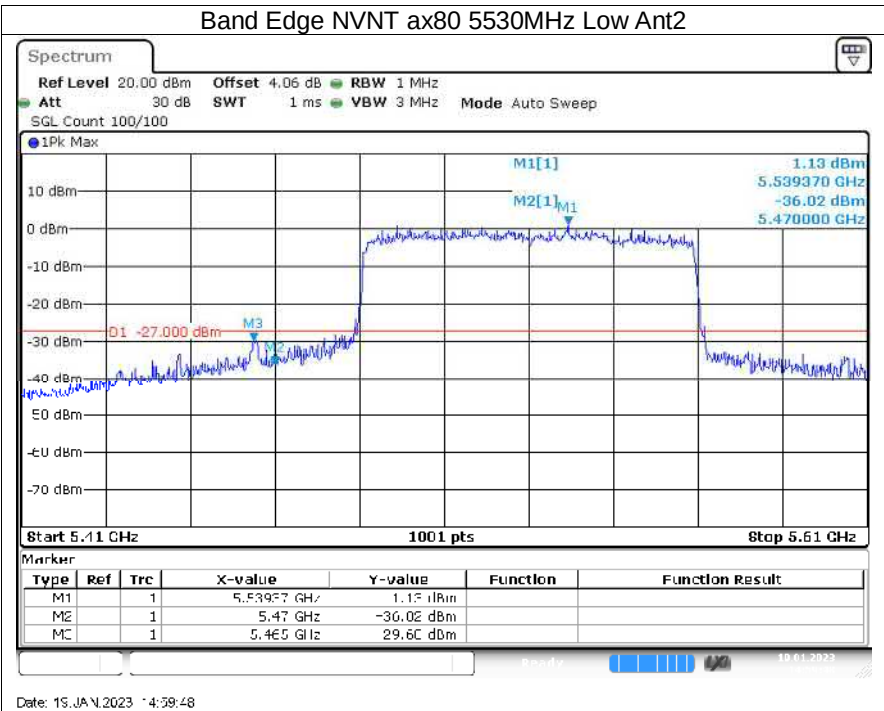


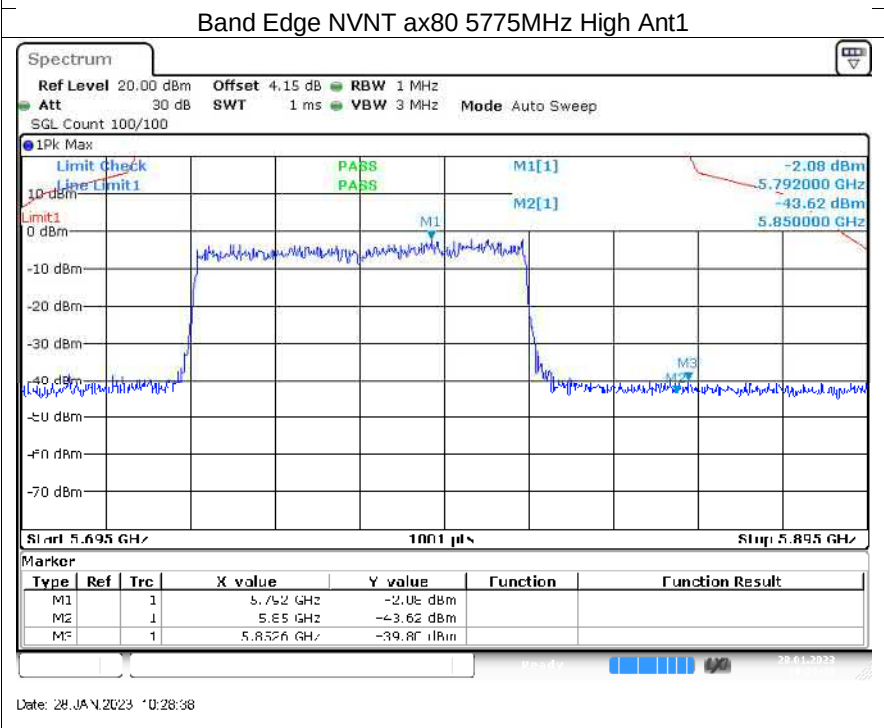

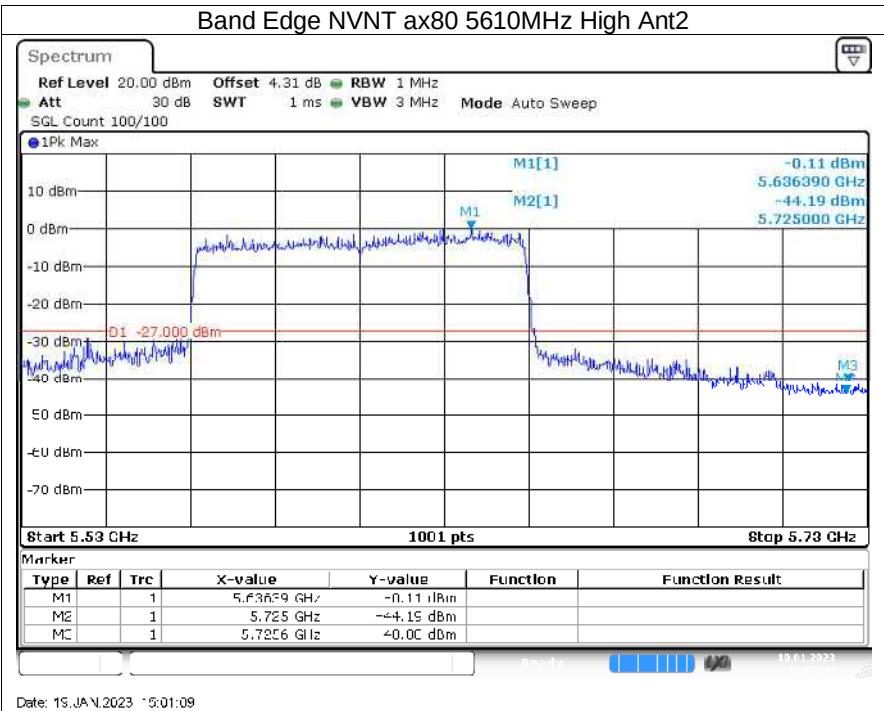

China

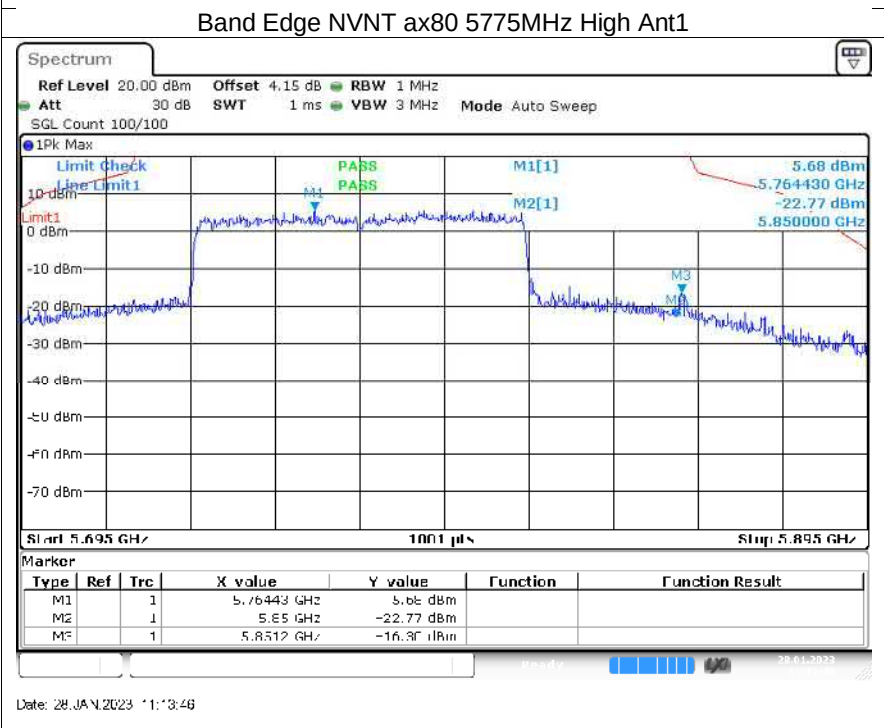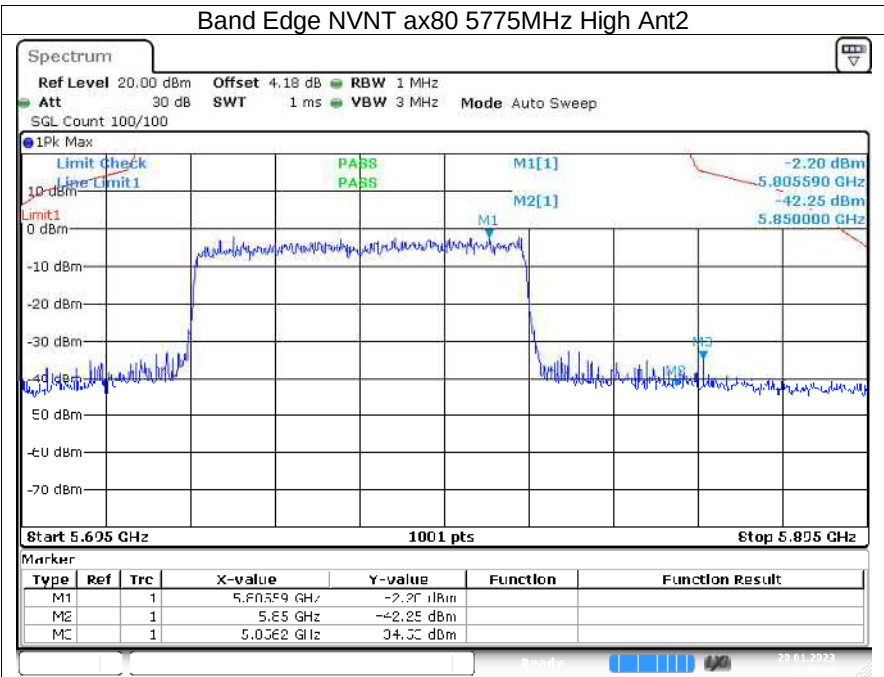

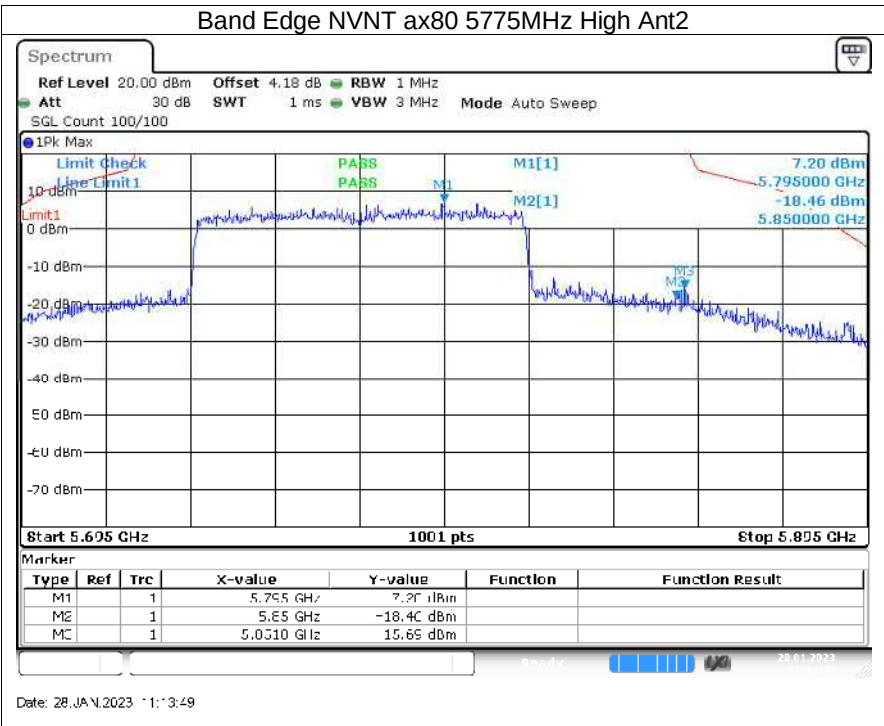

7 Frequency Stability

Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
20C 102V	a	5180	Ant1	5180.02	20000	3.86	25	Pass
20C 3.6V	a	5180	Ant1	5180.04	40000	7.72	25	Pass
20C 138V	a	5180	Ant1	5180.06	60000	11.58	25	Pass
10C 3.6V	a	5180	Ant1	5180.02	20000	3.86	25	Pass
30C 120V	a	5180	Ant1	5180.02	20000	3.86	25	Pass
40C 120V	a	5180	Ant1	5180.02	20000	3.86	25	Pass
20C 102V	a	5200	Ant1	5200.02	20000	3.85	25	Pass
20C 120V	a	5200	Ant1	5200.02	20000	3.85	25	Pass
20C 138V	a	5200	Ant1	5200	0	0	25	Pass
10C 120V	a	5200	Ant1	5200.02	20000	3.85	25	Pass
30C 120V	a	5200	Ant1	5200.02	20000	3.85	25	Pass
40C 120V	a	5200	Ant1	5200.04	40000	7.69	25	Pass
20C 102V	a	5240	Ant1	5240.02	20000	3.82	25	Pass
20C 120V	a	5240	Ant1	5240	0	0	25	Pass
20C 138V	a	5240	Ant1	5240.04	40000	7.63	25	Pass
10C 120V	a	5240	Ant1	5240.04	40000	7.63	25	Pass
30C 120V	a	5240	Ant1	5240.04	40000	7.63	25	Pass
40C 120V	a	5240	Ant1	5240.04	40000	7.63	25	Pass
20C 102V	a	5180	Ant2	5180.02	20000	3.86	25	Pass
20C 120V	a	5180	Ant2	5180.02	20000	3.86	25	Pass
20C 138V	a	5180	Ant2	5180.02	20000	3.86	25	Pass
10C 120V	a	5180	Ant2	5180.02	20000	3.86	25	Pass
30C 120V	a	5180	Ant2	5180.02	20000	3.86	25	Pass
40C 120V	a	5180	Ant2	5180.02	20000	3.86	25	Pass
20C 102V	a	5200	Ant2	5200	0	0	25	Pass
20C 120V	a	5200	Ant2	5200.02	20000	3.85	25	Pass
20C 138V	a	5200	Ant2	5200	0	0	25	Pass
10C 120V	a	5200	Ant2	5200	0	0	25	Pass
30C 120V	a	5200	Ant2	5200.02	20000	3.85	25	Pass
40C 120V	a	5200	Ant2	5200	0	0	25	Pass
20C 102V	a	5240	Ant2	5240.02	20000	3.82	25	Pass
20C 120V	a	5240	Ant2	5240	0	0	25	Pass
20C 138V	a	5240	Ant2	5240	0	0	25	Pass
10C 120V	a	5240	Ant2	5240.02	20000	3.82	25	Pass
30C 120V	a	5240	Ant2	5240.02	20000	3.82	25	Pass
40C 120V	a	5240	Ant2	5240.02	20000	3.82	25	Pass
20C 102V	a	5180	Ant1	5180.04	40000	7.72	25	Pass
20C 120V	a	5180	Ant1	5180.02	20000	3.86	25	Pass
20C 138V	a	5180	Ant1	5180.02	20000	3.86	25	Pass
30C 120V	a	5180	Ant1	5180.04	40000	7.72	25	Pass
20C 102V	a	5200	Ant1	5200	0	0	25	Pass
20C 120V	a	5200	Ant1	5200	0	0	25	Pass
10C 120V	a	5200	Ant1	5200	0	0	25	Pass
30C 120V	a	5200	Ant1	5200	0	0	25	Pass
40C 120V	a	5200	Ant1	5200	0	0	25	Pass
20C 102V	a	5260	Ant1	5260	0	0	25	Pass
20C 120V	a	5260	Ant1	5260	0	0	25	Pass
20C 138V	a	5260	Ant1	5260.02	20000	3.8	25	Pass
10C 120V	a	5260	Ant1	5260.04	40000	7.6	25	Pass
30C 120V	a	5260	Ant1	5260.02	20000	3.8	25	Pass
40C 120V	a	5260	Ant1	5260.04	40000	7.6	25	Pass



China

20C 102V	a	5300	Ant1	5300.04	40000	7.55	25	Pass
20C 120V	a	5300	Ant1	5300	0	0	25	Pass
20C 138V	a	5300	Ant1	5300.02	20000	3.77	25	Pass
10C 120V	a	5300	Ant1	5300.02	20000	3.77	25	Pass
30C 120V	a	5300	Ant1	5300	0	0	25	Pass
40C 120V	a	5300	Ant1	5300.04	40000	7.55	25	Pass
20C 102V	a	5320	Ant1	5320.02	20000	3.76	25	Pass
20C 120V	a	5320	Ant1	5320.04	40000	7.52	25	Pass
20C 138V	a	5320	Ant1	5320.06	60000	11.28	25	Pass
10C 120V	a	5320	Ant1	5320.04	40000	7.52	25	Pass
30C 120V	a	5320	Ant1	5320.04	40000	7.52	25	Pass
40C 120V	a	5320	Ant1	5320.02	20000	3.76	25	Pass
20C 102V	a	5260	Ant2	5260.02	20000	3.8	25	Pass
20C 120V	a	5260	Ant2	5260	0	0	25	Pass
20C 138V	a	5260	Ant2	5260	0	0	25	Pass
10C 120V	a	5260	Ant2	5260	0	0	25	Pass
30C 120V	a	5260	Ant2	5260.02	20000	3.8	25	Pass
40C 120V	a	5260	Ant2	5260	0	0	25	Pass
20C 102V	a	5300	Ant2	5300.02	20000	3.77	25	Pass
20C 120V	a	5300	Ant2	5300.02	20000	3.77	25	Pass
20C 138V	a	5300	Ant2	5300.02	20000	3.77	25	Pass
10C 120V	a	5300	Ant2	5300.02	20000	3.77	25	Pass
30C 120V	a	5300	Ant2	5300	0	0	25	Pass
40C 120V	a	5300	Ant2	5300.02	20000	3.77	25	Pass
20C 102V	a	5320	Ant2	5320.02	20000	3.76	25	Pass
20C 120V	a	5320	Ant2	5320.02	20000	3.76	25	Pass
20C 138V	a	5320	Ant2	5320	0	0	25	Pass
10C 120V	a	5320	Ant2	5320.04	40000	7.52	25	Pass
30C 120V	a	5320	Ant2	5320.04	40000	7.52	25	Pass
40C 120V	a	5320	Ant2	5320.02	20000	3.76	25	Pass
10C 120V	a	5260	Ant1	5260	0	0	25	Pass
40C 120V	a	5260	Ant1	5260.02	20000	3.8	25	Pass
20C 102V	a	5300	Ant1	5300	0	0	25	Pass
20C 120V	a	5300	Ant1	5300.04	40000	7.55	25	Pass
10C 120V	a	5300	Ant1	5300	0	0	25	Pass
30C 120V	a	5300	Ant1	5300.02	20000	3.77	25	Pass
40C 120V	a	5300	Ant1	5300.02	20000	3.77	25	Pass
20C 120V	a	5320	Ant1	5320	0	0	25	Pass
20C 138V	a	5320	Ant1	5320.02	20000	3.76	25	Pass
10C 120V	a	5320	Ant1	5320	0	0	25	Pass
30C 120V	a	5320	Ant1	5320	0	0	25	Pass
40C 120V	a	5320	Ant1	5320.04	40000	7.52	25	Pass
20C 102V	a	5700	Ant2	5700.02	20000	3.51	25	Pass
20C 120V	a	5700	Ant2	5700	0	0	25	Pass
20C 138V	a	5700	Ant2	5700	0	0	25	Pass
10C 120V	a	5700	Ant2	5700	0	0	25	Pass
30C 120V	a	5700	Ant2	5699.98	-20000	-3.51	25	Pass
40C 120V	a	5700	Ant2	5700	0	0	25	Pass
20C 102V	a	5500	Ant1	5500	0	0	25	Pass
20C 120V	a	5500	Ant1	5499.98	-20000	-3.64	25	Pass
20C 138V	a	5500	Ant1	5500	0	0	25	Pass
10C 120V	a	5500	Ant1	5500.04	40000	7.27	25	Pass
30C 120V	a	5500	Ant1	5500.02	20000	3.64	25	Pass
40C 120V	a	5500	Ant1	5500.06	60000	10.91	25	Pass
20C 102V	a	5600	Ant1	5600.04	40000	7.14	25	Pass
20C 120V	a	5600	Ant1	5600	0	0	25	Pass



China

20C 138V	a	5600	Ant1	5600.02	20000	3.57	25	Pass
10C 120V	a	5600	Ant1	5600	0	0	25	Pass
30C 120V	a	5600	Ant1	5600.02	20000	3.57	25	Pass
40C 120V	a	5600	Ant1	5600.02	20000	3.57	25	Pass
20C 102V	a	5700	Ant1	5700.02	20000	3.51	25	Pass
20C 120V	a	5700	Ant1	5700	0	0	25	Pass
20C 138V	a	5700	Ant1	5700	0	0	25	Pass
10C 120V	a	5700	Ant1	5700.02	20000	3.51	25	Pass
30C 120V	a	5700	Ant1	5700	0	0	25	Pass
40C 120V	a	5700	Ant1	5700.02	20000	3.51	25	Pass
20C 102V	a	5720	Ant1	5720	0	0	25	Pass
20C 120V	a	5720	Ant1	5720	0	0	25	Pass
20C 138V	a	5720	Ant1	5720	0	0	25	Pass
10C 120V	a	5720	Ant1	5720	0	0	25	Pass
30C 120V	a	5720	Ant1	5720	0	0	25	Pass
40C 120V	a	5720	Ant1	5720	0	0	25	Pass
20C 102V	a	5745	Ant1	5745.02	20000	3.48	25	Pass
20C 120V	a	5745	Ant1	5745.02	20000	3.48	25	Pass
20C 138V	a	5745	Ant1	5745.02	20000	3.48	25	Pass
10C 120V	a	5745	Ant1	5745	0	0	25	Pass
30C 120V	a	5745	Ant1	5745	0	0	25	Pass
40C 120V	a	5745	Ant1	5745.02	20000	3.48	25	Pass
20C 102V	a	5785	Ant1	5785.02	20000	3.46	25	Pass
20C 120V	a	5785	Ant1	5785	0	0	25	Pass
20C 138V	a	5785	Ant1	5785.02	20000	3.46	25	Pass
10C 120V	a	5785	Ant1	5785	0	0	25	Pass
30C 120V	a	5785	Ant1	5785	0	0	25	Pass
40C 120V	a	5785	Ant1	5785.04	40000	6.91	25	Pass
20C 102V	a	5825	Ant1	5825.02	20000	3.43	25	Pass
20C 120V	a	5825	Ant1	5825.02	20000	3.43	25	Pass
20C 138V	a	5825	Ant1	5825.02	20000	3.43	25	Pass
10C 120V	a	5825	Ant1	5825.02	20000	3.43	25	Pass
30C 120V	a	5825	Ant1	5825	0	0	25	Pass
40C 120V	a	5825	Ant1	5825.02	20000	3.43	25	Pass
20C 102V	n20	5180	Ant1	5180.04	40000	7.72	25	Pass
20C 120V	n20	5180	Ant1	5180.04	40000	7.72	25	Pass
10C 120V	n20	5180	Ant1	5180.02	20000	3.86	25	Pass
30C 120V	n20	5180	Ant1	5180.02	20000	3.86	25	Pass
40C 120V	n20	5180	Ant1	5180.04	40000	7.72	25	Pass
20C 102V	n20	5200	Ant1	5200.02	20000	3.85	25	Pass
20C 120V	n20	5200	Ant1	5200.04	40000	7.69	25	Pass
20C 138V	n20	5200	Ant1	5200	0	0	25	Pass
10C 120V	n20	5200	Ant1	5200	0	0	25	Pass
30C 120V	n20	5200	Ant1	5200.02	20000	3.85	25	Pass
40C 120V	n20	5200	Ant1	5200.02	20000	3.85	25	Pass
20C 102V	n20	5240	Ant1	5240.02	20000	3.82	25	Pass
20C 120V	n20	5240	Ant1	5240.02	20000	3.82	25	Pass
20C 138V	n20	5240	Ant1	5240.02	20000	3.82	25	Pass
10C 120V	n20	5240	Ant1	5240.04	40000	7.63	25	Pass
30C 120V	n20	5240	Ant1	5240.06	60000	11.45	25	Pass
40C 120V	n20	5240	Ant1	5240.04	40000	7.63	25	Pass
20C 102V	n20	5180	Ant2	5180.02	20000	3.86	25	Pass
20C 120V	n20	5180	Ant2	5180.02	20000	3.86	25	Pass
20C 138V	n20	5180	Ant2	5180	0	0	25	Pass
10C 120V	n20	5180	Ant2	5180.04	40000	7.72	25	Pass
30C 120V	n20	5180	Ant2	5180.02	20000	3.86	25	Pass



China

40C 120V	n20	5180	Ant2	5180	0	0	25	Pass
20C 102V	n20	5200	Ant2	5200.02	20000	3.85	25	Pass
20C 120V	n20	5200	Ant2	5200.04	40000	7.69	25	Pass
20C 138V	n20	5200	Ant2	5200.04	40000	7.69	25	Pass
10C 120V	n20	5200	Ant2	5200.02	20000	3.85	25	Pass
30C 120V	n20	5200	Ant2	5200	0	0	25	Pass
40C 120V	n20	5200	Ant2	5200.04	40000	7.69	25	Pass
20C 102V	n20	5240	Ant2	5240.04	40000	7.63	25	Pass
20C 120V	n20	5240	Ant2	5240.04	40000	7.63	25	Pass
20C 138V	n20	5240	Ant2	5240.02	20000	3.82	25	Pass
10C 120V	n20	5240	Ant2	5240.06	60000	11.45	25	Pass
30C 120V	n20	5240	Ant2	5240.02	20000	3.82	25	Pass
40C 120V	n20	5240	Ant2	5240.04	40000	7.63	25	Pass
20C 102V	n20	5260	Ant1	5260	0	0	25	Pass
20C 120V	n20	5260	Ant1	5260.02	20000	3.8	25	Pass
20C 138V	n20	5260	Ant1	5260.06	60000	11.41	25	Pass
10C 120V	n20	5260	Ant1	5260	0	0	25	Pass
30C 120V	n20	5260	Ant1	5260.04	40000	7.6	25	Pass
40C 120V	n20	5260	Ant1	5260.02	20000	3.8	25	Pass
20C 102V	n20	5300	Ant1	5300.02	20000	3.77	25	Pass
20C 120V	n20	5300	Ant1	5300.02	20000	3.77	25	Pass
20C 138V	n20	5300	Ant1	5300.04	40000	7.55	25	Pass
10C 120V	n20	5300	Ant1	5300.02	20000	3.77	25	Pass
30C 120V	n20	5300	Ant1	5300	0	0	25	Pass
40C 120V	n20	5300	Ant1	5300.02	20000	3.77	25	Pass
20C 102V	n20	5320	Ant1	5320	0	0	25	Pass
20C 120V	n20	5320	Ant1	5320.02	20000	3.76	25	Pass
20C 138V	n20	5320	Ant1	5320	0	0	25	Pass
10C 120V	n20	5320	Ant1	5320.02	20000	3.76	25	Pass
30C 120V	n20	5320	Ant1	5320.02	20000	3.76	25	Pass
40C 120V	n20	5320	Ant1	5320	0	0	25	Pass
20C 102V	n20	5260	Ant2	5260.04	40000	7.6	25	Pass
20C 120V	n20	5260	Ant2	5260.02	20000	3.8	25	Pass
20C 138V	n20	5260	Ant2	5260.02	20000	3.8	25	Pass
10C 120V	n20	5260	Ant2	5260.02	20000	3.8	25	Pass
30C 120V	n20	5260	Ant2	5260	0	0	25	Pass
40C 120V	n20	5260	Ant2	5260	0	0	25	Pass
20C 102V	n20	5300	Ant2	5300.02	20000	3.77	25	Pass
20C 120V	n20	5300	Ant2	5300	0	0	25	Pass
20C 138V	n20	5300	Ant2	5300	0	0	25	Pass
10C 120V	n20	5300	Ant2	5300.02	20000	3.77	25	Pass
30C 120V	n20	5300	Ant2	5300.04	40000	7.55	25	Pass
40C 120V	n20	5300	Ant2	5300.04	40000	7.55	25	Pass
20C 102V	n20	5320	Ant2	5320	0	0	25	Pass
20C 120V	n20	5320	Ant2	5320	0	0	25	Pass
20C 138V	n20	5320	Ant2	5320.02	20000	3.76	25	Pass
10C 120V	n20	5320	Ant2	5320.02	20000	3.76	25	Pass
30C 120V	n20	5320	Ant2	5320.02	20000	3.76	25	Pass
40C 120V	n20	5320	Ant2	5320.04	40000	7.52	25	Pass
20C 102V	n20	5500	Ant1	5500.04	40000	7.27	25	Pass
20C 120V	n20	5500	Ant1	5500.02	20000	3.64	25	Pass
20C 138V	n20	5500	Ant1	5500.02	20000	3.64	25	Pass
10C 120V	n20	5500	Ant1	5499.98	-20000	-3.64	25	Pass
30C 120V	n20	5500	Ant1	5500.04	40000	7.27	25	Pass
40C 120V	n20	5500	Ant1	5500.04	40000	7.27	25	Pass
20C 102V	n20	5600	Ant1	5600.04	40000	7.14	25	Pass



China

20C 120V	n20	5600	Ant1	5600	0	0	25	Pass
20C 138V	n20	5600	Ant1	5600.04	40000	7.14	25	Pass
10C 120V	n20	5600	Ant1	5600.02	20000	3.57	25	Pass
30C 120V	n20	5600	Ant1	5600	0	0	25	Pass
40C 120V	n20	5600	Ant1	5600.02	20000	3.57	25	Pass
20C 102V	n20	5700	Ant1	5700.02	20000	3.51	25	Pass
20C 120V	n20	5700	Ant1	5700.04	40000	7.02	25	Pass
20C 138V	n20	5700	Ant1	5700	0	0	25	Pass
10C 120V	n20	5700	Ant1	5700.02	20000	3.51	25	Pass
30C 120V	n20	5700	Ant1	5700.04	40000	7.02	25	Pass
40C 120V	n20	5700	Ant1	5700.04	40000	7.02	25	Pass
20C 102V	n20	5500	Ant2	5500.02	20000	3.64	25	Pass
20C 120V	n20	5500	Ant2	5500.02	20000	3.64	25	Pass
20C 138V	n20	5500	Ant2	5500	0	0	25	Pass
10C 120V	n20	5500	Ant2	5500.02	20000	3.64	25	Pass
30C 120V	n20	5500	Ant2	5500.04	40000	7.27	25	Pass
40C 120V	n20	5500	Ant2	5500.02	20000	3.64	25	Pass
20C 102V	n20	5600	Ant2	5600.02	20000	3.57	25	Pass
20C 120V	n20	5600	Ant2	5600.02	20000	3.57	25	Pass
20C 138V	n20	5600	Ant2	5600.02	20000	3.57	25	Pass
10C 120V	n20	5600	Ant2	5600.04	40000	7.14	25	Pass
30C 120V	n20	5600	Ant2	5600.02	20000	3.57	25	Pass
40C 120V	n20	5600	Ant2	5600.02	20000	3.57	25	Pass
20C 102V	n20	5700	Ant2	5700.02	20000	3.51	25	Pass
20C 120V	n20	5700	Ant2	5700.02	20000	3.51	25	Pass
20C 138V	n20	5700	Ant2	5700.02	20000	3.51	25	Pass
10C 120V	n20	5700	Ant2	5700.02	20000	3.51	25	Pass
30C 120V	n20	5700	Ant2	5700.02	20000	3.51	25	Pass
40C 120V	n20	5700	Ant2	5700.02	20000	3.51	25	Pass
20C 102V	n20	5720	Ant1	5720	0	0	25	Pass
20C 120V	n20	5720	Ant1	5720	0	0	25	Pass
20C 138V	n20	5720	Ant1	5720	0	0	25	Pass
10C 120V	n20	5720	Ant1	5720	0	0	25	Pass
30C 120V	n20	5720	Ant1	5720	0	0	25	Pass
40C 120V	n20	5720	Ant1	5720	0	0	25	Pass
20C 102V	n20	5720	Ant2	5720.02	20000	3.5	25	Pass
20C 120V	n20	5720	Ant2	5720.02	20000	3.5	25	Pass
20C 138V	n20	5720	Ant2	5720.04	40000	6.99	25	Pass
10C 120V	n20	5720	Ant2	5720	0	0	25	Pass
30C 120V	n20	5720	Ant2	5720.02	20000	3.5	25	Pass
40C 120V	n20	5720	Ant2	5720.04	40000	6.99	25	Pass
20C 102V	n20	5745	Ant1	5745.06	60000	10.44	25	Pass
20C 120V	n20	5745	Ant1	5745.04	40000	6.96	25	Pass
20C 138V	n20	5745	Ant1	5745.02	20000	3.48	25	Pass
10C 120V	n20	5745	Ant1	5745.02	20000	3.48	25	Pass
30C 120V	n20	5745	Ant1	5745.06	60000	10.44	25	Pass
40C 120V	n20	5745	Ant1	5745.04	40000	6.96	25	Pass
20C 102V	n20	5785	Ant1	5785.02	20000	3.46	25	Pass
20C 120V	n20	5785	Ant1	5785.04	40000	6.91	25	Pass
20C 138V	n20	5785	Ant1	5785.02	20000	3.46	25	Pass
10C 120V	n20	5785	Ant1	5785	0	0	25	Pass
30C 120V	n20	5785	Ant1	5785.04	40000	6.91	25	Pass
40C 120V	n20	5785	Ant1	5785.04	40000	6.91	25	Pass
20C 102V	n20	5825	Ant1	5825.02	20000	3.43	25	Pass
20C 120V	n20	5825	Ant1	5825.02	20000	3.43	25	Pass
20C 138V	n20	5825	Ant1	5825.02	20000	3.43	25	Pass



China

10C 120V	n20	5825	Ant1	5825.02	20000	3.43	25	Pass
30C 120V	n20	5825	Ant1	5825.04	40000	6.87	25	Pass
40C 120V	n20	5825	Ant1	5825.04	40000	6.87	25	Pass
20C 102V	n20	5745	Ant2	5745.02	20000	3.48	25	Pass
20C 120V	n20	5745	Ant2	5745.02	20000	3.48	25	Pass
20C 138V	n20	5745	Ant2	5745.02	20000	3.48	25	Pass
10C 120V	n20	5745	Ant2	5745.04	40000	6.96	25	Pass
30C 120V	n20	5745	Ant2	5745.02	20000	3.48	25	Pass
40C 120V	n20	5745	Ant2	5745.04	40000	6.96	25	Pass
20C 102V	n20	5785	Ant2	5785	0	0	25	Pass
20C 120V	n20	5785	Ant2	5785.04	40000	6.91	25	Pass
20C 138V	n20	5785	Ant2	5785.02	20000	3.46	25	Pass
10C 120V	n20	5785	Ant2	5785.04	40000	6.91	25	Pass
30C 120V	n20	5785	Ant2	5785.02	20000	3.46	25	Pass
40C 120V	n20	5785	Ant2	5785.02	20000	3.46	25	Pass
20C 102V	n20	5825	Ant2	5825.02	20000	3.43	25	Pass
20C 120V	n20	5825	Ant2	5825.04	40000	6.87	25	Pass
20C 138V	n20	5825	Ant2	5825	0	0	25	Pass
10C 120V	n20	5825	Ant2	5825.02	20000	3.43	25	Pass
30C 120V	n20	5825	Ant2	5825	0	0	25	Pass
40C 120V	n20	5825	Ant2	5825.02	20000	3.43	25	Pass
20C 102V	n40	5190	Ant1	5190	0	0	25	Pass
20C 120V	n40	5190	Ant1	5190	0	0	25	Pass
20C 138V	n40	5190	Ant1	5190	0	0	25	Pass
10C 120V	n40	5190	Ant1	5190.04	40000	7.71	25	Pass
30C 120V	n40	5190	Ant1	5190	0	0	25	Pass
40C 120V	n40	5190	Ant1	5190	0	0	25	Pass
20C 102V	n40	5230	Ant1	5230.04	40000	7.65	25	Pass
20C 120V	n40	5230	Ant1	5230	0	0	25	Pass
20C 138V	n40	5230	Ant1	5230	0	0	25	Pass
10C 120V	n40	5230	Ant1	5230	0	0	25	Pass
30C 120V	n40	5230	Ant1	5230.04	40000	7.65	25	Pass
40C 120V	n40	5230	Ant1	5230.04	40000	7.65	25	Pass
20C 102V	n40	5190	Ant2	5190.08	80000	15.41	25	Pass
20C 120V	n40	5190	Ant2	5190.04	40000	7.71	25	Pass
20C 138V	n40	5190	Ant2	5190	0	0	25	Pass
10C 120V	n40	5190	Ant2	5190.04	40000	7.71	25	Pass
30C 120V	n40	5190	Ant2	5190	0	0	25	Pass
40C 120V	n40	5190	Ant2	5190	0	0	25	Pass
20C 102V	n40	5230	Ant2	5230.08	80000	15.3	25	Pass
20C 120V	n40	5230	Ant2	5230	0	0	25	Pass
20C 138V	n40	5230	Ant2	5230.04	40000	7.65	25	Pass
10C 120V	n40	5230	Ant2	5230.04	40000	7.65	25	Pass
30C 120V	n40	5230	Ant2	5230.08	80000	15.3	25	Pass
40C 120V	n40	5230	Ant2	5230	0	0	25	Pass
20C 102V	n40	5270	Ant1	5270	0	0	25	Pass
20C 120V	n40	5270	Ant1	5270.04	40000	7.59	25	Pass
20C 138V	n40	5270	Ant1	5270.04	40000	7.59	25	Pass
10C 120V	n40	5270	Ant1	5270	0	0	25	Pass
30C 120V	n40	5270	Ant1	5270.04	40000	7.59	25	Pass
40C 120V	n40	5270	Ant1	5270.04	40000	7.59	25	Pass
20C 102V	n40	5310	Ant1	5310	0	0	25	Pass
20C 120V	n40	5310	Ant1	5310	0	0	25	Pass
20C 138V	n40	5310	Ant1	5310	0	0	25	Pass
10C 120V	n40	5310	Ant1	5310	0	0	25	Pass
30C 120V	n40	5310	Ant1	5310	0	0	25	Pass



China

40C 120V	n40	5310	Ant1	5310	0	0	25	Pass
20C 102V	n40	5270	Ant2	5270	0	0	25	Pass
20C 120V	n40	5270	Ant2	5270	0	0	25	Pass
20C 138V	n40	5270	Ant2	5270	0	0	25	Pass
10C 120V	n40	5270	Ant2	5270	0	0	25	Pass
30C 120V	n40	5270	Ant2	5270.04	40000	7.59	25	Pass
40C 120V	n40	5270	Ant2	5270	0	0	25	Pass
20C 102V	n40	5310	Ant2	5310	0	0	25	Pass
20C 120V	n40	5310	Ant2	5310.04	40000	7.53	25	Pass
20C 138V	n40	5310	Ant2	5310	0	0	25	Pass
10C 120V	n40	5310	Ant2	5310	0	0	25	Pass
30C 120V	n40	5310	Ant2	5310	0	0	25	Pass
40C 120V	n40	5310	Ant2	5310	0	0	25	Pass
20C 102V	n40	5510	Ant1	5510	0	0	25	Pass
20C 120V	n40	5510	Ant1	5510	0	0	25	Pass
20C 138V	n40	5510	Ant1	5510	0	0	25	Pass
10C 120V	n40	5510	Ant1	5510	0	0	25	Pass
30C 120V	n40	5510	Ant1	5510.04	40000	7.26	25	Pass
40C 120V	n40	5510	Ant1	5510.04	40000	7.26	25	Pass
20C 102V	n40	5590	Ant1	5590	0	0	25	Pass
20C 120V	n40	5590	Ant1	5589.96	-40000	-7.16	25	Pass
20C 138V	n40	5590	Ant1	5590	0	0	25	Pass
10C 120V	n40	5590	Ant1	5590.04	40000	7.16	25	Pass
30C 120V	n40	5590	Ant1	5590.04	40000	7.16	25	Pass
40C 120V	n40	5590	Ant1	5590.04	40000	7.16	25	Pass
20C 102V	n40	5670	Ant1	5670.04	40000	7.05	25	Pass
20C 120V	n40	5670	Ant1	5670	0	0	25	Pass
20C 138V	n40	5670	Ant1	5670	0	0	25	Pass
10C 120V	n40	5670	Ant1	5670	0	0	25	Pass
30C 120V	n40	5670	Ant1	5670	0	0	25	Pass
40C 120V	n40	5670	Ant1	5670	0	0	25	Pass
20C 102V	n40	5510	Ant2	5510	0	0	25	Pass
20C 120V	n40	5510	Ant2	5510	0	0	25	Pass
20C 138V	n40	5510	Ant2	5510.04	40000	7.26	25	Pass
10C 120V	n40	5510	Ant2	5510	0	0	25	Pass
30C 120V	n40	5510	Ant2	5510.04	40000	7.26	25	Pass
40C 120V	n40	5510	Ant2	5510	0	0	25	Pass
20C 102V	n40	5590	Ant2	5590.04	40000	7.16	25	Pass
20C 120V	n40	5590	Ant2	5590.08	80000	14.31	25	Pass
20C 138V	n40	5590	Ant2	5590.04	40000	7.16	25	Pass
10C 120V	n40	5590	Ant2	5590.04	40000	7.16	25	Pass
30C 120V	n40	5590	Ant2	5590.08	80000	14.31	25	Pass
40C 120V	n40	5590	Ant2	5590.08	80000	14.31	25	Pass
20C 102V	n40	5670	Ant2	5670.04	40000	7.05	25	Pass
20C 120V	n40	5670	Ant2	5670.04	40000	7.05	25	Pass
20C 138V	n40	5670	Ant2	5670.04	40000	7.05	25	Pass
10C 120V	n40	5670	Ant2	5670.04	40000	7.05	25	Pass
30C 120V	n40	5670	Ant2	5670.04	40000	7.05	25	Pass
40C 120V	n40	5670	Ant2	5670.04	40000	7.05	25	Pass
20C 102V	n40	5710	Ant1	5710.08	80000	14.01	25	Pass
20C 120V	n40	5710	Ant1	5710	0	0	25	Pass
20C 138V	n40	5710	Ant1	5710.04	40000	7.01	25	Pass
10C 120V	n40	5710	Ant1	5710	0	0	25	Pass
30C 120V	n40	5710	Ant1	5710	0	0	25	Pass
40C 120V	n40	5710	Ant1	5710.04	40000	7.01	25	Pass
20C 102V	n40	5710	Ant2	5710	0	0	25	Pass



China

20C 120V	n40	5710	Ant2	5710.04	40000	7.01	25	Pass
20C 138V	n40	5710	Ant2	5710.04	40000	7.01	25	Pass
10C 120V	n40	5710	Ant2	5710.04	40000	7.01	25	Pass
30C 120V	n40	5710	Ant2	5710.04	40000	7.01	25	Pass
40C 120V	n40	5710	Ant2	5710.04	40000	7.01	25	Pass
20C 102V	n40	5755	Ant1	5755.04	40000	6.95	25	Pass
20C 120V	n40	5755	Ant1	5755.04	40000	6.95	25	Pass
20C 138V	n40	5755	Ant1	5755	0	0	25	Pass
10C 120V	n40	5755	Ant1	5755.04	40000	6.95	25	Pass
30C 120V	n40	5755	Ant1	5755.08	80000	13.9	25	Pass
40C 120V	n40	5755	Ant1	5755.04	40000	6.95	25	Pass
20C 102V	n40	5795	Ant1	5795	0	0	25	Pass
20C 120V	n40	5795	Ant1	5795.04	40000	6.9	25	Pass
20C 138V	n40	5795	Ant1	5795.04	40000	6.9	25	Pass
10C 120V	n40	5795	Ant1	5795.04	40000	6.9	25	Pass
30C 120V	n40	5795	Ant1	5795	0	0	25	Pass
40C 120V	n40	5795	Ant1	5795.08	80000	13.81	25	Pass
20C 102V	n40	5755	Ant2	5755	0	0	25	Pass
20C 120V	n40	5755	Ant2	5755	0	0	25	Pass
20C 138V	n40	5755	Ant2	5755	0	0	25	Pass
10C 120V	n40	5755	Ant2	5755	0	0	25	Pass
30C 120V	n40	5755	Ant2	5755	0	0	25	Pass
40C 120V	n40	5755	Ant2	5755.08	80000	13.9	25	Pass
20C 102V	n40	5795	Ant2	5795.04	40000	6.9	25	Pass
20C 120V	n40	5795	Ant2	5795	0	0	25	Pass
20C 138V	n40	5795	Ant2	5795	0	0	25	Pass
10C 120V	n40	5795	Ant2	5795.04	40000	6.9	25	Pass
30C 120V	n40	5795	Ant2	5795	0	0	25	Pass
40C 120V	n40	5795	Ant2	5795	0	0	25	Pass
20C 102V	ac20	5180	Ant1	5180.04	40000	7.72	25	Pass
20C 120V	ac20	5180	Ant1	5180.04	40000	7.72	25	Pass
20C 138V	ac20	5180	Ant1	5180.04	40000	7.72	25	Pass
10C 120V	ac20	5180	Ant1	5180.02	20000	3.86	25	Pass
30C 120V	ac20	5180	Ant1	5180.04	40000	7.72	25	Pass
40C 120V	ac20	5180	Ant1	5180.04	40000	7.72	25	Pass
20C 102V	ac20	5200	Ant1	5200	0	0	25	Pass
20C 120V	ac20	5200	Ant1	5200.02	20000	3.85	25	Pass
20C 138V	ac20	5200	Ant1	5200.04	40000	7.69	25	Pass
10C 120V	ac20	5200	Ant1	5200	0	0	25	Pass
30C 120V	ac20	5200	Ant1	5200	0	0	25	Pass
40C 120V	ac20	5200	Ant1	5200.02	20000	3.85	25	Pass
20C 102V	ac20	5240	Ant1	5240.04	40000	7.63	25	Pass
20C 120V	ac20	5240	Ant1	5240.04	40000	7.63	25	Pass
20C 138V	ac20	5240	Ant1	5240.04	40000	7.63	25	Pass
10C 120V	ac20	5240	Ant1	5240.04	40000	7.63	25	Pass
30C 120V	ac20	5240	Ant1	5240.02	20000	3.82	25	Pass
40C 120V	ac20	5240	Ant1	5240.04	40000	7.63	25	Pass
20C 102V	ac20	5180	Ant2	5180	0	0	25	Pass
20C 120V	ac20	5180	Ant2	5180	0	0	25	Pass
20C 138V	ac20	5180	Ant2	5180.02	20000	3.86	25	Pass
10C 120V	ac20	5180	Ant2	5180.02	20000	3.86	25	Pass
30C 120V	ac20	5180	Ant2	5180.02	20000	3.86	25	Pass
40C 120V	ac20	5180	Ant2	5180	0	0	25	Pass
20C 102V	ac20	5200	Ant2	5200.04	40000	7.69	25	Pass
20C 120V	ac20	5200	Ant2	5200.02	20000	3.85	25	Pass
20C 138V	ac20	5200	Ant2	5200.02	20000	3.85	25	Pass



China

10C 120V	ac20	5200	Ant2	5200.04	40000	7.69	25	Pass
30C 120V	ac20	5200	Ant2	5200	0	0	25	Pass
40C 120V	ac20	5200	Ant2	5200.04	40000	7.69	25	Pass
20C 102V	ac20	5240	Ant2	5240.02	20000	3.82	25	Pass
20C 120V	ac20	5240	Ant2	5240.04	40000	7.63	25	Pass
20C 138V	ac20	5240	Ant2	5240.04	40000	7.63	25	Pass
10C 120V	ac20	5240	Ant2	5240.02	20000	3.82	25	Pass
30C 120V	ac20	5240	Ant2	5240.02	20000	3.82	25	Pass
40C 120V	ac20	5240	Ant2	5240.04	40000	7.63	25	Pass
20C 102V	ac20	5260	Ant1	5260.04	40000	7.6	25	Pass
20C 120V	ac20	5260	Ant1	5260.04	40000	7.6	25	Pass
20C 138V	ac20	5260	Ant1	5260	0	0	25	Pass
10C 120V	ac20	5260	Ant1	5260	0	0	25	Pass
30C 120V	ac20	5260	Ant1	5260.04	40000	7.6	25	Pass
40C 120V	ac20	5260	Ant1	5260.04	40000	7.6	25	Pass
20C 102V	ac20	5300	Ant1	5300.02	20000	3.77	25	Pass
20C 120V	ac20	5300	Ant1	5300.04	40000	7.55	25	Pass
20C 138V	ac20	5300	Ant1	5300.02	20000	3.77	25	Pass
10C 120V	ac20	5300	Ant1	5300.02	20000	3.77	25	Pass
30C 120V	ac20	5300	Ant1	5300	0	0	25	Pass
40C 120V	ac20	5300	Ant1	5300.04	40000	7.55	25	Pass
20C 102V	ac20	5320	Ant1	5320.02	20000	3.76	25	Pass
20C 120V	ac20	5320	Ant1	5320.02	20000	3.76	25	Pass
20C 138V	ac20	5320	Ant1	5320	0	0	25	Pass
10C 120V	ac20	5320	Ant1	5320.02	20000	3.76	25	Pass
30C 120V	ac20	5320	Ant1	5320.02	20000	3.76	25	Pass
40C 120V	ac20	5320	Ant1	5320.02	20000	3.76	25	Pass
20C 102V	ac20	5260	Ant2	5260	0	0	25	Pass
20C 120V	ac20	5260	Ant2	5260	0	0	25	Pass
20C 138V	ac20	5260	Ant2	5260.02	20000	3.8	25	Pass
10C 120V	ac20	5260	Ant2	5260.04	40000	7.6	25	Pass
30C 120V	ac20	5260	Ant2	5260	0	0	25	Pass
40C 120V	ac20	5260	Ant2	5260	0	0	25	Pass
20C 102V	ac20	5300	Ant2	5300	0	0	25	Pass
20C 120V	ac20	5300	Ant2	5300.04	40000	7.55	25	Pass
20C 138V	ac20	5300	Ant2	5300.04	40000	7.55	25	Pass
10C 120V	ac20	5300	Ant2	5300.02	20000	3.77	25	Pass
30C 120V	ac20	5300	Ant2	5300	0	0	25	Pass
40C 120V	ac20	5300	Ant2	5300.04	40000	7.55	25	Pass
20C 102V	ac20	5320	Ant2	5320.04	40000	7.52	25	Pass
20C 120V	ac20	5320	Ant2	5320.04	40000	7.52	25	Pass
20C 138V	ac20	5320	Ant2	5320.04	40000	7.52	25	Pass
10C 120V	ac20	5320	Ant2	5320.02	20000	3.76	25	Pass
30C 120V	ac20	5320	Ant2	5320.02	20000	3.76	25	Pass
40C 120V	ac20	5320	Ant2	5320.04	40000	7.52	25	Pass
20C 102V	ac20	5500	Ant1	5500	0	0	25	Pass
20C 120V	ac20	5500	Ant1	5500	0	0	25	Pass
20C 138V	ac20	5500	Ant1	5500.04	40000	7.27	25	Pass
10C 120V	ac20	5500	Ant1	5500	0	0	25	Pass
30C 120V	ac20	5500	Ant1	5500.02	20000	3.64	25	Pass
40C 120V	ac20	5500	Ant1	5500.02	20000	3.64	25	Pass
20C 102V	ac20	5600	Ant1	5600.02	20000	3.57	25	Pass
20C 120V	ac20	5600	Ant1	5600.02	20000	3.57	25	Pass
20C 138V	ac20	5600	Ant1	5600.02	20000	3.57	25	Pass
10C 120V	ac20	5600	Ant1	5600	0	0	25	Pass
30C 120V	ac20	5600	Ant1	5600.02	20000	3.57	25	Pass



China

40C 120V	ac20	5600	Ant1	5600.02	20000	3.57	25	Pass
20C 102V	ac20	5700	Ant1	5700.04	40000	7.02	25	Pass
20C 120V	ac20	5700	Ant1	5700.04	40000	7.02	25	Pass
20C 138V	ac20	5700	Ant1	5700.04	40000	7.02	25	Pass
10C 120V	ac20	5700	Ant1	5700.04	40000	7.02	25	Pass
30C 120V	ac20	5700	Ant1	5700.04	40000	7.02	25	Pass
40C 120V	ac20	5700	Ant1	5700	0	0	25	Pass
20C 102V	ac20	5500	Ant2	5500	0	0	25	Pass
20C 120V	ac20	5500	Ant2	5500.02	20000	3.64	25	Pass
20C 138V	ac20	5500	Ant2	5500.02	20000	3.64	25	Pass
10C 120V	ac20	5500	Ant2	5500.02	20000	3.64	25	Pass
30C 120V	ac20	5500	Ant2	5500.04	40000	7.27	25	Pass
40C 120V	ac20	5500	Ant2	5500.02	20000	3.64	25	Pass
20C 102V	ac20	5600	Ant2	5600	0	0	25	Pass
20C 120V	ac20	5600	Ant2	5600.02	20000	3.57	25	Pass
20C 138V	ac20	5600	Ant2	5600.04	40000	7.14	25	Pass
10C 120V	ac20	5600	Ant2	5600.04	40000	7.14	25	Pass
30C 120V	ac20	5600	Ant2	5600.02	20000	3.57	25	Pass
40C 120V	ac20	5600	Ant2	5600.04	40000	7.14	25	Pass
20C 102V	ac20	5700	Ant2	5700.02	20000	3.51	25	Pass
20C 120V	ac20	5700	Ant2	5700.02	20000	3.51	25	Pass
20C 138V	ac20	5700	Ant2	5700	0	0	25	Pass
10C 120V	ac20	5700	Ant2	5700.04	40000	7.02	25	Pass
30C 120V	ac20	5700	Ant2	5700.02	20000	3.51	25	Pass
40C 120V	ac20	5700	Ant2	5700.02	20000	3.51	25	Pass
20C 102V	ac20	5720	Ant1	5720.02	20000	3.5	25	Pass
20C 120V	ac20	5720	Ant1	5720.04	40000	6.99	25	Pass
20C 138V	ac20	5720	Ant1	5720.02	20000	3.5	25	Pass
10C 120V	ac20	5720	Ant1	5720.02	20000	3.5	25	Pass
30C 120V	ac20	5720	Ant1	5720.02	20000	3.5	25	Pass
40C 120V	ac20	5720	Ant1	5720.02	20000	3.5	25	Pass
20C 102V	ac20	5720	Ant2	5720.04	40000	6.99	25	Pass
20C 120V	ac20	5720	Ant2	5720.02	20000	3.5	25	Pass
20C 138V	ac20	5720	Ant2	5720.04	40000	6.99	25	Pass
10C 120V	ac20	5720	Ant2	5720.02	20000	3.5	25	Pass
30C 120V	ac20	5720	Ant2	5720	0	0	25	Pass
40C 120V	ac20	5720	Ant2	5720.04	40000	6.99	25	Pass
20C 102V	ac20	5745	Ant1	5745	0	0	25	Pass
20C 120V	ac20	5745	Ant1	5745.04	40000	6.96	25	Pass
20C 138V	ac20	5745	Ant1	5745.04	40000	6.96	25	Pass
10C 120V	ac20	5745	Ant1	5745.02	20000	3.48	25	Pass
30C 120V	ac20	5745	Ant1	5745.02	20000	3.48	25	Pass
40C 120V	ac20	5745	Ant1	5745	0	0	25	Pass
20C 102V	ac20	5785	Ant1	5785.04	40000	6.91	25	Pass
20C 120V	ac20	5785	Ant1	5785.02	20000	3.46	25	Pass
20C 138V	ac20	5785	Ant1	5785.02	20000	3.46	25	Pass
10C 120V	ac20	5785	Ant1	5785.02	20000	3.46	25	Pass
30C 120V	ac20	5785	Ant1	5785.02	20000	3.46	25	Pass
40C 120V	ac20	5785	Ant1	5785.04	40000	6.91	25	Pass
20C 102V	ac20	5825	Ant1	5825	0	0	25	Pass
20C 120V	ac20	5825	Ant1	5825.04	40000	6.87	25	Pass
20C 138V	ac20	5825	Ant1	5825.02	20000	3.43	25	Pass
10C 120V	ac20	5825	Ant1	5825.04	40000	6.87	25	Pass
30C 120V	ac20	5825	Ant1	5825.04	40000	6.87	25	Pass
40C 120V	ac20	5825	Ant1	5825.02	20000	3.43	25	Pass
20C 102V	ac20	5745	Ant2	5745.04	40000	6.96	25	Pass



China

20C 120V	ac20	5745	Ant2	5745.02	20000	3.48	25	Pass
20C 138V	ac20	5745	Ant2	5745.04	40000	6.96	25	Pass
10C 120V	ac20	5745	Ant2	5745.04	40000	6.96	25	Pass
30C 120V	ac20	5745	Ant2	5745.02	20000	3.48	25	Pass
40C 120V	ac20	5745	Ant2	5745.02	20000	3.48	25	Pass
20C 102V	ac20	5785	Ant2	5785.02	20000	3.46	25	Pass
20C 120V	ac20	5785	Ant2	5785.04	40000	6.91	25	Pass
20C 138V	ac20	5785	Ant2	5785.04	40000	6.91	25	Pass
10C 120V	ac20	5785	Ant2	5785.04	40000	6.91	25	Pass
30C 120V	ac20	5785	Ant2	5785.04	40000	6.91	25	Pass
40C 120V	ac20	5785	Ant2	5785.02	20000	3.46	25	Pass
20C 102V	ac20	5825	Ant2	5825.02	20000	3.43	25	Pass
20C 120V	ac20	5825	Ant2	5825	0	0	25	Pass
20C 138V	ac20	5825	Ant2	5825.02	20000	3.43	25	Pass
10C 120V	ac20	5825	Ant2	5825.04	40000	6.87	25	Pass
30C 120V	ac20	5825	Ant2	5825.04	40000	6.87	25	Pass
40C 120V	ac20	5825	Ant2	5825.04	40000	6.87	25	Pass
20C 102V	ac40	5190	Ant1	5190	0	0	25	Pass
20C 120V	ac40	5190	Ant1	5190.04	40000	7.71	25	Pass
20C 138V	ac40	5190	Ant1	5190.04	40000	7.71	25	Pass
10C 120V	ac40	5190	Ant1	5190	0	0	25	Pass
30C 120V	ac40	5190	Ant1	5190	0	0	25	Pass
40C 120V	ac40	5190	Ant1	5190.04	40000	7.71	25	Pass
20C 102V	ac40	5230	Ant1	5230.04	40000	7.65	25	Pass
20C 120V	ac40	5230	Ant1	5230.04	40000	7.65	25	Pass
20C 138V	ac40	5230	Ant1	5230.04	40000	7.65	25	Pass
10C 120V	ac40	5230	Ant1	5230.04	40000	7.65	25	Pass
30C 120V	ac40	5230	Ant1	5230	0	0	25	Pass
40C 120V	ac40	5230	Ant1	5230.04	40000	7.65	25	Pass
20C 102V	ac40	5190	Ant2	5190.04	40000	7.71	25	Pass
20C 120V	ac40	5190	Ant2	5190	0	0	25	Pass
20C 138V	ac40	5190	Ant2	5190	0	0	25	Pass
10C 120V	ac40	5190	Ant2	5190	0	0	25	Pass
30C 120V	ac40	5190	Ant2	5190.04	40000	7.71	25	Pass
40C 120V	ac40	5190	Ant2	5190	0	0	25	Pass
20C 102V	ac40	5230	Ant2	5230	0	0	25	Pass
20C 120V	ac40	5230	Ant2	5230.04	40000	7.65	25	Pass
20C 138V	ac40	5230	Ant2	5230.04	40000	7.65	25	Pass
10C 120V	ac40	5230	Ant2	5230	0	0	25	Pass
30C 120V	ac40	5230	Ant2	5230.04	40000	7.65	25	Pass
40C 120V	ac40	5230	Ant2	5230	0	0	25	Pass
20C 102V	ac40	5270	Ant1	5270.04	40000	7.59	25	Pass
20C 120V	ac40	5270	Ant1	5270	0	0	25	Pass
20C 138V	ac40	5270	Ant1	5270.04	40000	7.59	25	Pass
10C 120V	ac40	5270	Ant1	5270	0	0	25	Pass
30C 120V	ac40	5270	Ant1	5270.04	40000	7.59	25	Pass
40C 120V	ac40	5270	Ant1	5270.04	40000	7.59	25	Pass
20C 102V	ac40	5310	Ant1	5310.04	40000	7.53	25	Pass
20C 120V	ac40	5310	Ant1	5310	0	0	25	Pass
20C 138V	ac40	5310	Ant1	5310	0	0	25	Pass
10C 120V	ac40	5310	Ant1	5310.04	40000	7.53	25	Pass
30C 120V	ac40	5310	Ant1	5310	0	0	25	Pass
40C 120V	ac40	5310	Ant1	5310.04	40000	7.53	25	Pass
20C 102V	ac40	5270	Ant2	5270.04	40000	7.59	25	Pass
20C 120V	ac40	5270	Ant2	5270.04	40000	7.59	25	Pass
20C 138V	ac40	5270	Ant2	5270	0	0	25	Pass



China

10C 120V	ac40	5270	Ant2	5270.04	40000	7.59	25	Pass
30C 120V	ac40	5270	Ant2	5270	0	0	25	Pass
40C 120V	ac40	5270	Ant2	5270.04	40000	7.59	25	Pass
20C 102V	ac40	5310	Ant2	5310.04	40000	7.53	25	Pass
20C 120V	ac40	5310	Ant2	5310.04	40000	7.53	25	Pass
20C 138V	ac40	5310	Ant2	5310.04	40000	7.53	25	Pass
10C 120V	ac40	5310	Ant2	5310.04	40000	7.53	25	Pass
30C 120V	ac40	5310	Ant2	5310.04	40000	7.53	25	Pass
40C 120V	ac40	5310	Ant2	5310.04	40000	7.53	25	Pass
20C 102V	ac40	5510	Ant1	5510.04	40000	7.26	25	Pass
20C 120V	ac40	5510	Ant1	5510.04	40000	7.26	25	Pass
20C 138V	ac40	5510	Ant1	5510.04	40000	7.26	25	Pass
10C 120V	ac40	5510	Ant1	5510	0	0	25	Pass
30C 120V	ac40	5510	Ant1	5510.04	40000	7.26	25	Pass
40C 120V	ac40	5510	Ant1	5510.04	40000	7.26	25	Pass
20C 102V	ac40	5590	Ant1	5590	0	0	25	Pass
20C 120V	ac40	5590	Ant1	5590.04	40000	7.16	25	Pass
20C 138V	ac40	5590	Ant1	5590.04	40000	7.16	25	Pass
10C 120V	ac40	5590	Ant1	5590	0	0	25	Pass
30C 120V	ac40	5590	Ant1	5590.04	40000	7.16	25	Pass
40C 120V	ac40	5590	Ant1	5590.04	40000	7.16	25	Pass
20C 102V	ac40	5670	Ant1	5670	0	0	25	Pass
20C 120V	ac40	5670	Ant1	5670.04	40000	7.05	25	Pass
20C 138V	ac40	5670	Ant1	5670.04	40000	7.05	25	Pass
10C 120V	ac40	5670	Ant1	5670.04	40000	7.05	25	Pass
30C 120V	ac40	5670	Ant1	5670	0	0	25	Pass
40C 120V	ac40	5670	Ant1	5670.04	40000	7.05	25	Pass
20C 102V	ac40	5510	Ant2	5510.04	40000	7.26	25	Pass
20C 120V	ac40	5510	Ant2	5510.04	40000	7.26	25	Pass
20C 138V	ac40	5510	Ant2	5510.04	40000	7.26	25	Pass
10C 120V	ac40	5510	Ant2	5510.04	40000	7.26	25	Pass
30C 120V	ac40	5510	Ant2	5510.04	40000	7.26	25	Pass
40C 120V	ac40	5510	Ant2	5510.04	40000	7.26	25	Pass
20C 102V	ac40	5590	Ant2	5590.04	40000	7.16	25	Pass
20C 120V	ac40	5590	Ant2	5590	0	0	25	Pass
20C 138V	ac40	5590	Ant2	5590.04	40000	7.16	25	Pass
10C 120V	ac40	5590	Ant2	5590	0	0	25	Pass
30C 120V	ac40	5590	Ant2	5590.04	40000	7.16	25	Pass
40C 120V	ac40	5590	Ant2	5590.04	40000	7.16	25	Pass
20C 102V	ac40	5670	Ant2	5670.04	40000	7.05	25	Pass
20C 120V	ac40	5670	Ant2	5670	0	0	25	Pass
20C 138V	ac40	5670	Ant2	5670.04	40000	7.05	25	Pass
10C 120V	ac40	5670	Ant2	5670.04	40000	7.05	25	Pass
30C 120V	ac40	5670	Ant2	5670.04	40000	7.05	25	Pass
40C 120V	ac40	5670	Ant2	5670.04	40000	7.05	25	Pass
20C 102V	ac40	5710	Ant1	5710.04	40000	7.01	25	Pass
20C 120V	ac40	5710	Ant1	5710.04	40000	7.01	25	Pass
20C 138V	ac40	5710	Ant1	5710.04	40000	7.01	25	Pass
10C 120V	ac40	5710	Ant1	5710.04	40000	7.01	25	Pass
30C 120V	ac40	5710	Ant1	5710.04	40000	7.01	25	Pass
40C 120V	ac40	5710	Ant1	5710.04	40000	7.01	25	Pass
20C 102V	ac40	5710	Ant2	5710	0	0	25	Pass
20C 120V	ac40	5710	Ant2	5710.04	40000	7.01	25	Pass
20C 138V	ac40	5710	Ant2	5710.04	40000	7.01	25	Pass
10C 120V	ac40	5710	Ant2	5710.04	40000	7.01	25	Pass
30C 120V	ac40	5710	Ant2	5710	0	0	25	Pass



China

40C 120V	ac40	5710	Ant2	5710.04	40000	7.01	25	Pass
20C 102V	ac40	5755	Ant1	5755.04	40000	6.95	25	Pass
20C 120V	ac40	5755	Ant1	5755.04	40000	6.95	25	Pass
20C 138V	ac40	5755	Ant1	5755.04	40000	6.95	25	Pass
10C 120V	ac40	5755	Ant1	5755.04	40000	6.95	25	Pass
30C 120V	ac40	5755	Ant1	5755	0	0	25	Pass
40C 120V	ac40	5755	Ant1	5755.04	40000	6.95	25	Pass
20C 102V	ac40	5795	Ant1	5795.04	40000	6.9	25	Pass
20C 120V	ac40	5795	Ant1	5795.08	80000	13.81	25	Pass
20C 138V	ac40	5795	Ant1	5795	0	0	25	Pass
10C 120V	ac40	5795	Ant1	5795.04	40000	6.9	25	Pass
30C 120V	ac40	5795	Ant1	5795.04	40000	6.9	25	Pass
40C 120V	ac40	5795	Ant1	5795.04	40000	6.9	25	Pass
20C 102V	ac40	5755	Ant2	5755.04	40000	6.95	25	Pass
20C 120V	ac40	5755	Ant2	5755	0	0	25	Pass
20C 138V	ac40	5755	Ant2	5755.04	40000	6.95	25	Pass
10C 120V	ac40	5755	Ant2	5755.04	40000	6.95	25	Pass
30C 120V	ac40	5755	Ant2	5755	0	0	25	Pass
40C 120V	ac40	5755	Ant2	5755	0	0	25	Pass
20C 102V	ac40	5795	Ant2	5795.04	40000	6.9	25	Pass
20C 120V	ac40	5795	Ant2	5795	0	0	25	Pass
20C 138V	ac40	5795	Ant2	5795.04	40000	6.9	25	Pass
10C 120V	ac40	5795	Ant2	5795	0	0	25	Pass
30C 120V	ac40	5795	Ant2	5795.04	40000	6.9	25	Pass
40C 120V	ac40	5795	Ant2	5795	0	0	25	Pass
20C 102V	ac80	5210	Ant1	5210	0	0	25	Pass
20C 120V	ac80	5210	Ant1	5210	0	0	25	Pass
20C 138V	ac80	5210	Ant1	5210	0	0	25	Pass
10C 120V	ac80	5210	Ant1	5210	0	0	25	Pass
30C 120V	ac80	5210	Ant1	5210.08	80000	15.36	25	Pass
40C 120V	ac80	5210	Ant1	5210	0	0	25	Pass
20C 102V	ac80	5210	Ant2	5210	0	0	25	Pass
20C 120V	ac80	5210	Ant2	5210	0	0	25	Pass
20C 138V	ac80	5210	Ant2	5210	0	0	25	Pass
10C 120V	ac80	5210	Ant2	5210	0	0	25	Pass
30C 120V	ac80	5210	Ant2	5210	0	0	25	Pass
40C 120V	ac80	5210	Ant2	5210	0	0	25	Pass
50C 120V	ac80	5210	Ant2	5210	0	0	25	Pass
10C 120V	ac80	5290	Ant1	5290	0	0	25	Pass
30C 120V	ac80	5290	Ant1	5290	0	0	25	Pass
40C 120V	ac80	5290	Ant1	5290	0	0	25	Pass
20C 102V	ac80	5290	Ant2	5290	0	0	25	Pass
20C 120V	ac80	5290	Ant2	5290	0	0	25	Pass
20C 138V	ac80	5290	Ant2	5290	0	0	25	Pass
10C 120V	ac80	5290	Ant2	5290	0	0	25	Pass
30C 120V	ac80	5290	Ant2	5290.08	80000	15.12	25	Pass
40C 120V	ac80	5290	Ant2	5290	0	0	25	Pass
20C 102V	ac80	5530	Ant1	5530	0	0	25	Pass
20C 120V	ac80	5530	Ant1	5530	0	0	25	Pass
20C 138V	ac80	5530	Ant1	5530	0	0	25	Pass
10C 120V	ac80	5530	Ant1	5530	0	0	25	Pass
30C 120V	ac80	5530	Ant1	5530	0	0	25	Pass
40C 120V	ac80	5530	Ant1	5530	0	0	25	Pass
20C 102V	ac80	5610	Ant1	5610	0	0	25	Pass
20C 120V	ac80	5610	Ant1	5610	0	0	25	Pass
20C 138V	ac80	5610	Ant1	5610	0	0	25	Pass



China

10C 120V	ac80	5610	Ant1	5610	0	0	25	Pass
30C 120V	ac80	5610	Ant1	5610	0	0	25	Pass
40C 120V	ac80	5610	Ant1	5610	0	0	25	Pass
20C 102V	ac80	5530	Ant2	5530	0	0	25	Pass
20C 120V	ac80	5530	Ant2	5530.08	80000	14.47	25	Pass
20C 138V	ac80	5530	Ant2	5530.08	80000	14.47	25	Pass
10C 120V	ac80	5530	Ant2	5530	0	0	25	Pass
30C 120V	ac80	5530	Ant2	5530	0	0	25	Pass
40C 120V	ac80	5530	Ant2	5530	0	0	25	Pass
20C 102V	ac80	5610	Ant2	5610.08	80000	14.26	25	Pass
20C 120V	ac80	5610	Ant2	5610	0	0	25	Pass
20C 138V	ac80	5610	Ant2	5610.08	80000	14.26	25	Pass
10C 120V	ac80	5610	Ant2	5610.08	80000	14.26	25	Pass
30C 120V	ac80	5610	Ant2	5610.08	80000	14.26	25	Pass
40C 120V	ac80	5610	Ant2	5610.08	80000	14.26	25	Pass
20C 102V	ac80	5690	Ant1	5690	0	0	25	Pass
20C 120V	ac80	5690	Ant1	5690	0	0	25	Pass
20C 138V	ac80	5690	Ant1	5690	0	0	25	Pass
10C 120V	ac80	5690	Ant1	5690	0	0	25	Pass
30C 120V	ac80	5690	Ant1	5690	0	0	25	Pass
40C 120V	ac80	5690	Ant1	5690	0	0	25	Pass
20C 102V	ac80	5690	Ant2	5690	0	0	25	Pass
20C 120V	ac80	5690	Ant2	5690	0	0	25	Pass
20C 138V	ac80	5690	Ant2	5690.08	80000	14.06	25	Pass
10C 120V	ac80	5690	Ant2	5690	0	0	25	Pass
30C 120V	ac80	5690	Ant2	5690	0	0	25	Pass
40C 120V	ac80	5690	Ant2	5690	0	0	25	Pass
20C 102V	ac80	5775	Ant1	5775	0	0	25	Pass
20C 120V	ac80	5775	Ant1	5775	0	0	25	Pass
20C 138V	ac80	5775	Ant1	5775	0	0	25	Pass
10C 120V	ac80	5775	Ant1	5775	0	0	25	Pass
30C 120V	ac80	5775	Ant1	5775	0	0	25	Pass
40C 120V	ac80	5775	Ant1	5775	0	0	25	Pass
20C 102V	ac80	5775	Ant2	5775.08	80000	13.85	25	Pass
20C 120V	ac80	5775	Ant2	5775	0	0	25	Pass
20C 138V	ac80	5775	Ant2	5775.08	80000	13.85	25	Pass
10C 120V	ac80	5775	Ant2	5775	0	0	25	Pass
30C 120V	ac80	5775	Ant2	5775	0	0	25	Pass
40C 120V	ac80	5775	Ant2	5775	0	0	25	Pass
20C 102V	ax20	5180	Ant1	5180.02	20000	3.86	25	Pass
20C 120V	ax20	5180	Ant1	5180	0	0	25	Pass
20C 138V	ax20	5180	Ant1	5180.02	20000	3.86	25	Pass
10C 120V	ax20	5180	Ant1	5180.02	20000	3.86	25	Pass
30C 120V	ax20	5180	Ant1	5180.02	20000	3.86	25	Pass
40C 120V	ax20	5180	Ant1	5180.02	20000	3.86	25	Pass
20C 102V	ax20	5200	Ant1	5200.04	40000	7.69	25	Pass
20C 120V	ax20	5200	Ant1	5200.02	20000	3.85	25	Pass
20C 138V	ax20	5200	Ant1	5200	0	0	25	Pass
10C 120V	ax20	5200	Ant1	5200.02	20000	3.85	25	Pass
30C 120V	ax20	5200	Ant1	5200.02	20000	3.85	25	Pass
40C 120V	ax20	5200	Ant1	5200.02	20000	3.85	25	Pass
20C 102V	ax20	5240	Ant1	5240	0	0	25	Pass
20C 120V	ax20	5240	Ant1	5240.02	20000	3.82	25	Pass
20C 138V	ax20	5240	Ant1	5240.02	20000	3.82	25	Pass
10C 120V	ax20	5240	Ant1	5240.04	40000	7.63	25	Pass
30C 120V	ax20	5240	Ant1	5240.02	20000	3.82	25	Pass



China

40C 120V	ax20	5240	Ant1	5240.04	40000	7.63	25	Pass
20C 102V	ax20	5180	Ant2	5180.04	40000	7.72	25	Pass
20C 120V	ax20	5180	Ant2	5180	0	0	25	Pass
20C 138V	ax20	5180	Ant2	5180.02	20000	3.86	25	Pass
10C 120V	ax20	5180	Ant2	5180.02	20000	3.86	25	Pass
30C 120V	ax20	5180	Ant2	5180	0	0	25	Pass
40C 120V	ax20	5180	Ant2	5180	0	0	25	Pass
20C 102V	ax20	5200	Ant2	5200.04	40000	7.69	25	Pass
20C 120V	ax20	5200	Ant2	5200.02	20000	3.85	25	Pass
20C 138V	ax20	5200	Ant2	5200	0	0	25	Pass
10C 120V	ax20	5200	Ant2	5200.02	20000	3.85	25	Pass
30C 120V	ax20	5200	Ant2	5200.02	20000	3.85	25	Pass
40C 120V	ax20	5200	Ant2	5200	0	0	25	Pass
20C 102V	ax20	5240	Ant2	5240.02	20000	3.82	25	Pass
20C 120V	ax20	5240	Ant2	5240.04	40000	7.63	25	Pass
20C 138V	ax20	5240	Ant2	5240.02	20000	3.82	25	Pass
10C 120V	ax20	5240	Ant2	5240.04	40000	7.63	25	Pass
30C 120V	ax20	5240	Ant2	5240.02	20000	3.82	25	Pass
40C 120V	ax20	5240	Ant2	5240.02	20000	3.82	25	Pass
20C 102V	ax20	5260	Ant1	5260	0	0	25	Pass
20C 120V	ax20	5260	Ant1	5260.02	20000	3.8	25	Pass
20C 138V	ax20	5260	Ant1	5260.02	20000	3.8	25	Pass
10C 120V	ax20	5260	Ant1	5260	0	0	25	Pass
30C 120V	ax20	5260	Ant1	5260.02	20000	3.8	25	Pass
40C 120V	ax20	5260	Ant1	5260.02	20000	3.8	25	Pass
20C 102V	ax20	5300	Ant1	5300.04	40000	7.55	25	Pass
20C 120V	ax20	5300	Ant1	5300.02	20000	3.77	25	Pass
20C 138V	ax20	5300	Ant1	5300.02	20000	3.77	25	Pass
10C 120V	ax20	5300	Ant1	5300.02	20000	3.77	25	Pass
30C 120V	ax20	5300	Ant1	5300	0	0	25	Pass
40C 120V	ax20	5300	Ant1	5300.02	20000	3.77	25	Pass
20C 102V	ax20	5320	Ant1	5320	0	0	25	Pass
20C 120V	ax20	5320	Ant1	5320	0	0	25	Pass
20C 138V	ax20	5320	Ant1	5320	0	0	25	Pass
10C 120V	ax20	5320	Ant1	5320	0	0	25	Pass
30C 120V	ax20	5320	Ant1	5320.02	20000	3.76	25	Pass
40C 120V	ax20	5320	Ant1	5320	0	0	25	Pass
20C 102V	ax20	5260	Ant2	5260.02	20000	3.8	25	Pass
20C 120V	ax20	5260	Ant2	5260.04	40000	7.6	25	Pass
20C 138V	ax20	5260	Ant2	5260.02	20000	3.8	25	Pass
10C 120V	ax20	5260	Ant2	5260.02	20000	3.8	25	Pass
30C 120V	ax20	5260	Ant2	5260.02	20000	3.8	25	Pass
40C 120V	ax20	5260	Ant2	5260.02	20000	3.8	25	Pass
20C 102V	ax20	5300	Ant2	5300.02	20000	3.77	25	Pass
20C 120V	ax20	5300	Ant2	5300	0	0	25	Pass
20C 138V	ax20	5300	Ant2	5300.06	60000	11.32	25	Pass
10C 120V	ax20	5300	Ant2	5300	0	0	25	Pass
30C 120V	ax20	5300	Ant2	5300	0	0	25	Pass
40C 120V	ax20	5300	Ant2	5300.02	20000	3.77	25	Pass
20C 102V	ax20	5320	Ant2	5320	0	0	25	Pass
20C 120V	ax20	5320	Ant2	5320.02	20000	3.76	25	Pass
20C 138V	ax20	5320	Ant2	5320.02	20000	3.76	25	Pass
10C 120V	ax20	5320	Ant2	5320.02	20000	3.76	25	Pass
30C 120V	ax20	5320	Ant2	5320.04	40000	7.52	25	Pass
40C 120V	ax20	5320	Ant2	5320.02	20000	3.76	25	Pass
20C 102V	ax20	5500	Ant1	5500.02	20000	3.64	25	Pass



China

20C 120V	ax20	5500	Ant1	5500	0	0	25	Pass
20C 138V	ax20	5500	Ant1	5500.02	20000	3.64	25	Pass
10C 120V	ax20	5500	Ant1	5500	0	0	25	Pass
30C 120V	ax20	5500	Ant1	5500.02	20000	3.64	25	Pass
40C 120V	ax20	5500	Ant1	5500.02	20000	3.64	25	Pass
20C 102V	ax20	5600	Ant1	5600.04	40000	7.14	25	Pass
20C 120V	ax20	5600	Ant1	5600.04	40000	7.14	25	Pass
20C 138V	ax20	5600	Ant1	5600	0	0	25	Pass
10C 120V	ax20	5600	Ant1	5600.02	20000	3.57	25	Pass
30C 120V	ax20	5600	Ant1	5600.02	20000	3.57	25	Pass
40C 120V	ax20	5600	Ant1	5600.02	20000	3.57	25	Pass
20C 102V	ax20	5700	Ant1	5700.02	20000	3.51	25	Pass
20C 120V	ax20	5700	Ant1	5700.02	20000	3.51	25	Pass
20C 138V	ax20	5700	Ant1	5700.04	40000	7.02	25	Pass
10C 120V	ax20	5700	Ant1	5700.02	20000	3.51	25	Pass
30C 120V	ax20	5700	Ant1	5700.02	20000	3.51	25	Pass
40C 120V	ax20	5700	Ant1	5700.02	20000	3.51	25	Pass
20C 102V	ax20	5500	Ant2	5500.02	20000	3.64	25	Pass
20C 120V	ax20	5500	Ant2	5500	0	0	25	Pass
20C 138V	ax20	5500	Ant2	5500.02	20000	3.64	25	Pass
10C 120V	ax20	5500	Ant2	5500.02	20000	3.64	25	Pass
30C 120V	ax20	5500	Ant2	5500	0	0	25	Pass
40C 120V	ax20	5500	Ant2	5500.02	20000	3.64	25	Pass
20C 102V	ax20	5600	Ant2	5600.04	40000	7.14	25	Pass
20C 120V	ax20	5600	Ant2	5600.02	20000	3.57	25	Pass
20C 138V	ax20	5600	Ant2	5600.04	40000	7.14	25	Pass
10C 120V	ax20	5600	Ant2	5600.02	20000	3.57	25	Pass
30C 120V	ax20	5600	Ant2	5600.04	40000	7.14	25	Pass
40C 120V	ax20	5600	Ant2	5600.02	20000	3.57	25	Pass
20C 102V	ax20	5700	Ant2	5700.02	20000	3.51	25	Pass
20C 120V	ax20	5700	Ant2	5700.02	20000	3.51	25	Pass
20C 138V	ax20	5700	Ant2	5700	0	0	25	Pass
10C 120V	ax20	5700	Ant2	5700.02	20000	3.51	25	Pass
30C 120V	ax20	5700	Ant2	5700.04	40000	7.02	25	Pass
40C 120V	ax20	5700	Ant2	5700.02	20000	3.51	25	Pass
20C 102V	ax20	5720	Ant1	5720	0	0	25	Pass
20C 120V	ax20	5720	Ant1	5720.02	20000	3.5	25	Pass
20C 138V	ax20	5720	Ant1	5720.02	20000	3.5	25	Pass
10C 120V	ax20	5720	Ant1	5720.02	20000	3.5	25	Pass
30C 120V	ax20	5720	Ant1	5720.04	40000	6.99	25	Pass
40C 120V	ax20	5720	Ant1	5720.02	20000	3.5	25	Pass
20C 102V	ax20	5720	Ant2	5720	0	0	25	Pass
20C 120V	ax20	5720	Ant2	5720.04	40000	6.99	25	Pass
20C 138V	ax20	5720	Ant2	5720.04	40000	6.99	25	Pass
10C 120V	ax20	5720	Ant2	5720.02	20000	3.5	25	Pass
30C 120V	ax20	5720	Ant2	5720.04	40000	6.99	25	Pass
40C 120V	ax20	5720	Ant2	5720.02	20000	3.5	25	Pass
20C 102V	ax20	5745	Ant1	5745.02	20000	3.48	25	Pass
20C 120V	ax20	5745	Ant1	5745.04	40000	6.96	25	Pass
20C 138V	ax20	5745	Ant1	5745.04	40000	6.96	25	Pass
10C 120V	ax20	5745	Ant1	5745	0	0	25	Pass
30C 120V	ax20	5745	Ant1	5745.02	20000	3.48	25	Pass
40C 120V	ax20	5745	Ant1	5745.02	20000	3.48	25	Pass
20C 102V	ax20	5785	Ant1	5785.02	20000	3.46	25	Pass
20C 120V	ax20	5785	Ant1	5785.02	20000	3.46	25	Pass
20C 138V	ax20	5785	Ant1	5785.04	40000	6.91	25	Pass



China

10C 120V	ax20	5785	Ant1	5785	0	0	25	Pass
30C 120V	ax20	5785	Ant1	5785.02	20000	3.46	25	Pass
40C 120V	ax20	5785	Ant1	5785.02	20000	3.46	25	Pass
20C 102V	ax20	5825	Ant1	5825.04	40000	6.87	25	Pass
20C 120V	ax20	5825	Ant1	5825.04	40000	6.87	25	Pass
20C 138V	ax20	5825	Ant1	5825.02	20000	3.43	25	Pass
10C 120V	ax20	5825	Ant1	5825.04	40000	6.87	25	Pass
30C 120V	ax20	5825	Ant1	5825	0	0	25	Pass
40C 120V	ax20	5825	Ant1	5825.02	20000	3.43	25	Pass
20C 102V	ax20	5745	Ant2	5745.02	20000	3.48	25	Pass
20C 120V	ax20	5745	Ant2	5745	0	0	25	Pass
20C 138V	ax20	5745	Ant2	5745.02	20000	3.48	25	Pass
10C 120V	ax20	5745	Ant2	5745.02	20000	3.48	25	Pass
30C 120V	ax20	5745	Ant2	5745.02	20000	3.48	25	Pass
40C 120V	ax20	5745	Ant2	5745	0	0	25	Pass
20C 102V	ax20	5785	Ant2	5785.02	20000	3.46	25	Pass
20C 120V	ax20	5785	Ant2	5785.02	20000	3.46	25	Pass
20C 138V	ax20	5785	Ant2	5785.02	20000	3.46	25	Pass
10C 120V	ax20	5785	Ant2	5785.02	20000	3.46	25	Pass
30C 120V	ax20	5785	Ant2	5785.02	20000	3.46	25	Pass
40C 120V	ax20	5785	Ant2	5785	0	0	25	Pass
20C 102V	ax20	5825	Ant2	5825.02	20000	3.43	25	Pass
20C 120V	ax20	5825	Ant2	5825.04	40000	6.87	25	Pass
20C 138V	ax20	5825	Ant2	5825.04	40000	6.87	25	Pass
10C 120V	ax20	5825	Ant2	5825.02	20000	3.43	25	Pass
30C 120V	ax20	5825	Ant2	5825.04	40000	6.87	25	Pass
40C 120V	ax20	5825	Ant2	5825.02	20000	3.43	25	Pass
20C 102V	ax40	5190	Ant1	5190	0	0	25	Pass
20C 120V	ax40	5190	Ant1	5190	0	0	25	Pass
20C 138V	ax40	5190	Ant1	5190.04	40000	7.71	25	Pass
10C 120V	ax40	5190	Ant1	5190.04	40000	7.71	25	Pass
30C 120V	ax40	5190	Ant1	5190	0	0	25	Pass
40C 120V	ax40	5190	Ant1	5190.04	40000	7.71	25	Pass
20C 102V	ax40	5230	Ant1	5230.04	40000	7.65	25	Pass
20C 120V	ax40	5230	Ant1	5230.12	120000	22.94	25	Pass
20C 138V	ax40	5230	Ant1	5230	0	0	25	Pass
10C 120V	ax40	5230	Ant1	5230.04	40000	7.65	25	Pass
30C 120V	ax40	5230	Ant1	5230.04	40000	7.65	25	Pass
40C 120V	ax40	5230	Ant1	5230	0	0	25	Pass
20C 102V	ax40	5190	Ant2	5190	0	0	25	Pass
20C 120V	ax40	5190	Ant2	5190.04	40000	7.71	25	Pass
20C 138V	ax40	5190	Ant2	5190.04	40000	7.71	25	Pass
10C 120V	ax40	5190	Ant2	5190	0	0	25	Pass
30C 120V	ax40	5190	Ant2	5190.04	40000	7.71	25	Pass
40C 120V	ax40	5190	Ant2	5190.04	40000	7.71	25	Pass
20C 102V	ax40	5230	Ant2	5230	0	0	25	Pass
20C 120V	ax40	5230	Ant2	5229.96	-40000	-7.65	25	Pass
20C 138V	ax40	5230	Ant2	5230.04	40000	7.65	25	Pass
10C 120V	ax40	5230	Ant2	5230.04	40000	7.65	25	Pass
30C 120V	ax40	5230	Ant2	5230.04	40000	7.65	25	Pass
40C 120V	ax40	5230	Ant2	5230.04	40000	7.65	25	Pass
20C 102V	ax40	5270	Ant1	5270	0	0	25	Pass
20C 120V	ax40	5270	Ant1	5270	0	0	25	Pass
20C 138V	ax40	5270	Ant1	5270	0	0	25	Pass
10C 120V	ax40	5270	Ant1	5270	0	0	25	Pass
30C 120V	ax40	5270	Ant1	5270	0	0	25	Pass



China

40C 120V	ax40	5270	Ant1	5269.96	-40000	-7.59	25	Pass
20C 102V	ax40	5310	Ant1	5310.04	40000	7.53	25	Pass
20C 120V	ax40	5310	Ant1	5310	0	0	25	Pass
20C 138V	ax40	5310	Ant1	5310	0	0	25	Pass
10C 120V	ax40	5310	Ant1	5310.04	40000	7.53	25	Pass
30C 120V	ax40	5310	Ant1	5310	0	0	25	Pass
40C 120V	ax40	5310	Ant1	5310.04	40000	7.53	25	Pass
20C 102V	ax40	5270	Ant2	5270	0	0	25	Pass
20C 120V	ax40	5270	Ant2	5270	0	0	25	Pass
20C 138V	ax40	5270	Ant2	5270	0	0	25	Pass
10C 120V	ax40	5270	Ant2	5270	0	0	25	Pass
30C 120V	ax40	5270	Ant2	5270	0	0	25	Pass
40C 120V	ax40	5270	Ant2	5270	0	0	25	Pass
20C 102V	ax40	5310	Ant2	5310	0	0	25	Pass
20C 120V	ax40	5310	Ant2	5310.04	40000	7.53	25	Pass
20C 138V	ax40	5310	Ant2	5310	0	0	25	Pass
10C 120V	ax40	5310	Ant2	5310.04	40000	7.53	25	Pass
30C 120V	ax40	5310	Ant2	5310.04	40000	7.53	25	Pass
40C 120V	ax40	5310	Ant2	5310.04	40000	7.53	25	Pass
20C 102V	ax40	5510	Ant1	5510	0	0	25	Pass
20C 120V	ax40	5510	Ant1	5510	0	0	25	Pass
20C 138V	ax40	5510	Ant1	5510	0	0	25	Pass
10C 120V	ax40	5510	Ant1	5510.04	40000	7.26	25	Pass
30C 120V	ax40	5510	Ant1	5510.04	40000	7.26	25	Pass
40C 120V	ax40	5510	Ant1	5510	0	0	25	Pass
20C 102V	ax40	5590	Ant1	5590	0	0	25	Pass
20C 120V	ax40	5590	Ant1	5590	0	0	25	Pass
20C 138V	ax40	5590	Ant1	5590.04	40000	7.16	25	Pass
10C 120V	ax40	5590	Ant1	5590	0	0	25	Pass
30C 120V	ax40	5590	Ant1	5590	0	0	25	Pass
40C 120V	ax40	5590	Ant1	5590	0	0	25	Pass
20C 102V	ax40	5670	Ant1	5670	0	0	25	Pass
20C 120V	ax40	5670	Ant1	5670.04	40000	7.05	25	Pass
20C 138V	ax40	5670	Ant1	5670	0	0	25	Pass
10C 120V	ax40	5670	Ant1	5670.04	40000	7.05	25	Pass
30C 120V	ax40	5670	Ant1	5670	0	0	25	Pass
40C 120V	ax40	5670	Ant1	5670	0	0	25	Pass
20C 102V	ax40	5510	Ant2	5510	0	0	25	Pass
20C 120V	ax40	5510	Ant2	5510.04	40000	7.26	25	Pass
20C 138V	ax40	5510	Ant2	5510.04	40000	7.26	25	Pass
10C 120V	ax40	5510	Ant2	5510.04	40000	7.26	25	Pass
30C 120V	ax40	5510	Ant2	5510	0	0	25	Pass
40C 120V	ax40	5510	Ant2	5510.04	40000	7.26	25	Pass
20C 102V	ax40	5590	Ant2	5590.04	40000	7.16	25	Pass
20C 120V	ax40	5590	Ant2	5590	0	0	25	Pass
20C 138V	ax40	5590	Ant2	5590	0	0	25	Pass
10C 120V	ax40	5590	Ant2	5590.04	40000	7.16	25	Pass
30C 120V	ax40	5590	Ant2	5590.04	40000	7.16	25	Pass
40C 120V	ax40	5590	Ant2	5590	0	0	25	Pass
20C 102V	ax40	5670	Ant2	5670.04	40000	7.05	25	Pass
20C 120V	ax40	5670	Ant2	5670.04	40000	7.05	25	Pass
20C 138V	ax40	5670	Ant2	5670.04	40000	7.05	25	Pass
10C 120V	ax40	5670	Ant2	5670.04	40000	7.05	25	Pass
30C 120V	ax40	5670	Ant2	5670.04	40000	7.05	25	Pass
40C 120V	ax40	5670	Ant2	5670.04	40000	7.05	25	Pass
20C 102V	ax40	5710	Ant1	5710.04	40000	7.01	25	Pass



China

20C 120V	ax40	5710	Ant1	5710.04	40000	7.01	25	Pass
20C 138V	ax40	5710	Ant1	5710	0	0	25	Pass
10C 120V	ax40	5710	Ant1	5710	0	0	25	Pass
30C 120V	ax40	5710	Ant1	5710.04	40000	7.01	25	Pass
40C 120V	ax40	5710	Ant1	5710.04	40000	7.01	25	Pass
20C 102V	ax40	5710	Ant2	5710.04	40000	7.01	25	Pass
20C 120V	ax40	5710	Ant2	5710	0	0	25	Pass
20C 138V	ax40	5710	Ant2	5710.04	40000	7.01	25	Pass
10C 120V	ax40	5710	Ant2	5710.04	40000	7.01	25	Pass
30C 120V	ax40	5710	Ant2	5710.04	40000	7.01	25	Pass
40C 120V	ax40	5710	Ant2	5710	0	0	25	Pass
20C 102V	ax40	5755	Ant1	5755	0	0	25	Pass
20C 120V	ax40	5755	Ant1	5755.04	40000	6.95	25	Pass
20C 138V	ax40	5755	Ant1	5755.08	80000	13.9	25	Pass
10C 120V	ax40	5755	Ant1	5755.04	40000	6.95	25	Pass
30C 120V	ax40	5755	Ant1	5755	0	0	25	Pass
40C 120V	ax40	5755	Ant1	5755	0	0	25	Pass
20C 102V	ax40	5795	Ant1	5795.04	40000	6.9	25	Pass
20C 120V	ax40	5795	Ant1	5795.04	40000	6.9	25	Pass
20C 138V	ax40	5795	Ant1	5795.04	40000	6.9	25	Pass
10C 120V	ax40	5795	Ant1	5795.04	40000	6.9	25	Pass
30C 120V	ax40	5795	Ant1	5795.04	40000	6.9	25	Pass
40C 120V	ax40	5795	Ant1	5795	0	0	25	Pass
20C 102V	ax40	5755	Ant2	5755.04	40000	6.95	25	Pass
20C 120V	ax40	5755	Ant2	5755.04	40000	6.95	25	Pass
20C 138V	ax40	5755	Ant2	5755	0	0	25	Pass
10C 120V	ax40	5755	Ant2	5755.04	40000	6.95	25	Pass
30C 120V	ax40	5755	Ant2	5755.04	40000	6.95	25	Pass
40C 120V	ax40	5755	Ant2	5755.04	40000	6.95	25	Pass
20C 102V	ax40	5795	Ant2	5795	0	0	25	Pass
20C 120V	ax40	5795	Ant2	5795	0	0	25	Pass
20C 138V	ax40	5795	Ant2	5795	0	0	25	Pass
10C 120V	ax40	5795	Ant2	5795	0	0	25	Pass
30C 120V	ax40	5795	Ant2	5795	0	0	25	Pass
40C 120V	ax40	5795	Ant2	5795	0	0	25	Pass
20C 102V	ax80	5210	Ant1	5210.16	160000	30.71	25	Pass
20C 120V	ax80	5210	Ant1	5209.92	-80000	-15.36	25	Pass
20C 138V	ax80	5210	Ant1	5210	0	0	25	Pass
10C 120V	ax80	5210	Ant1	5210	0	0	25	Pass
30C 120V	ax80	5210	Ant1	5210	0	0	25	Pass
40C 120V	ax80	5210	Ant1	5210.08	80000	15.36	25	Pass
20C 102V	ax80	5210	Ant2	5210	0	0	25	Pass
20C 120V	ax80	5210	Ant2	5210.16	160000	30.71	25	Pass
20C 138V	ax80	5210	Ant2	5210.16	160000	30.71	25	Pass
10C 120V	ax80	5210	Ant2	5210	0	0	25	Pass
30C 120V	ax80	5210	Ant2	5210.08	80000	15.36	25	Pass
40C 120V	ax80	5210	Ant2	5210.16	160000	30.71	25	Pass
20C 102V	ax80	5290	Ant1	5290	0	0	25	Pass
20C 120V	ax80	5290	Ant1	5290.08	80000	15.12	25	Pass
20C 138V	ax80	5290	Ant1	5290	0	0	25	Pass
10C 120V	ax80	5290	Ant1	5290	0	0	25	Pass
30C 120V	ax80	5290	Ant1	5289.92	-80000	-15.12	25	Pass
40C 120V	ax80	5290	Ant1	5290.16	160000	30.25	25	Pass
20C 102V	ax80	5290	Ant2	5290	0	0	25	Pass
20C 120V	ax80	5290	Ant2	5290.08	80000	15.12	25	Pass
20C 138V	ax80	5290	Ant2	5290	0	0	25	Pass



China

10C 120V	ax80	5290	Ant2	5290	0	0	25	Pass
30C 120V	ax80	5290	Ant2	5290.08	80000	15.12	25	Pass
40C 120V	ax80	5290	Ant2	5290.16	160000	30.25	25	Pass
20C 102V	ax80	5530	Ant1	5530.08	80000	14.47	25	Pass
20C 120V	ax80	5530	Ant1	5530.16	160000	28.93	25	Pass
20C 138V	ax80	5530	Ant1	5530.08	80000	14.47	25	Pass
10C 120V	ax80	5530	Ant1	5530.08	80000	14.47	25	Pass
30C 120V	ax80	5530	Ant1	5530.08	80000	14.47	25	Pass
40C 120V	ax80	5530	Ant1	5530.08	80000	14.47	25	Pass
20C 102V	ax80	5530	Ant1	5530.08	80000	14.47	25	Pass
20C 120V	ax80	5530	Ant1	5530.16	160000	28.93	25	Pass
20C 138V	ax80	5530	Ant1	5530.08	80000	14.47	25	Pass
10C 120V	ax80	5530	Ant1	5530.08	80000	14.47	25	Pass
30C 120V	ax80	5530	Ant1	5530.08	80000	14.47	25	Pass
40C 120V	ax80	5530	Ant1	5530.08	80000	14.47	25	Pass
20C 102V	ax80	5610	Ant1	5610.08	80000	14.26	25	Pass
20C 120V	ax80	5610	Ant1	5610.08	80000	14.26	25	Pass
20C 138V	ax80	5610	Ant1	5610.08	80000	14.26	25	Pass
10C 120V	ax80	5610	Ant1	5610.08	80000	14.26	25	Pass
30C 120V	ax80	5610	Ant1	5610.08	80000	14.26	25	Pass
40C 120V	ax80	5610	Ant1	5610.08	80000	14.26	25	Pass
20C 102V	ax80	5530	Ant2	5530.08	80000	14.47	25	Pass
20C 120V	ax80	5530	Ant2	5530.08	80000	14.47	25	Pass
20C 138V	ax80	5530	Ant2	5530.08	80000	14.47	25	Pass
10C 120V	ax80	5530	Ant2	5530.08	80000	14.47	25	Pass
30C 120V	ax80	5530	Ant2	5530.08	80000	14.47	25	Pass
40C 120V	ax80	5530	Ant2	5530.08	80000	14.47	25	Pass
20C 102V	ax80	5610	Ant2	5610.08	80000	14.26	25	Pass
20C 120V	ax80	5610	Ant2	5610.08	80000	14.26	25	Pass
20C 138V	ax80	5610	Ant2	5610.08	80000	14.26	25	Pass
10C 120V	ax80	5610	Ant2	5610.16	160000	28.52	25	Pass
30C 120V	ax80	5610	Ant2	5610.08	80000	14.26	25	Pass
40C 120V	ax80	5610	Ant2	5610.16	160000	28.52	25	Pass
20C 102V	ax80	5690	Ant1	5690.08	80000	14.06	25	Pass
20C 120V	ax80	5690	Ant1	5690.08	80000	14.06	25	Pass
20C 138V	ax80	5690	Ant1	5690.08	80000	14.06	25	Pass
10C 120V	ax80	5690	Ant1	5690.08	80000	14.06	25	Pass
30C 120V	ax80	5690	Ant1	5690.08	80000	14.06	25	Pass
40C 120V	ax80	5690	Ant1	5690.08	80000	14.06	25	Pass
20C 102V	ax80	5690	Ant2	5690.08	80000	14.06	25	Pass
20C 120V	ax80	5690	Ant2	5690.08	80000	14.06	25	Pass
20C 138V	ax80	5690	Ant2	5690.08	80000	14.06	25	Pass
10C 120V	ax80	5690	Ant2	5690.08	80000	14.06	25	Pass
30C 120V	ax80	5690	Ant2	5690.08	80000	14.06	25	Pass
40C 120V	ax80	5690	Ant2	5690.08	80000	14.06	25	Pass
20C 102V	ax80	5775	Ant1	5775.08	80000	13.85	25	Pass
20C 120V	ax80	5775	Ant1	5775.08	80000	13.85	25	Pass
20C 138V	ax80	5775	Ant1	5775.08	80000	13.85	25	Pass
10C 120V	ax80	5775	Ant1	5775.16	160000	27.71	25	Pass
30C 120V	ax80	5775	Ant1	5775.08	80000	13.85	25	Pass
40C 120V	ax80	5775	Ant1	5775.08	80000	13.85	25	Pass
20C 102V	ax80	5775	Ant2	5775.08	80000	13.85	25	Pass
20C 120V	ax80	5775	Ant2	5775	0	0	25	Pass
20C 138V	ax80	5775	Ant2	5775.08	80000	13.85	25	Pass
10C 120V	ax80	5775	Ant2	5775.08	80000	13.85	25	Pass
30C 120V	ax80	5775	Ant2	5775.08	80000	13.85	25	Pass

8 Conducted RF Spurious Emission

Condition	Mode	Frequency (MHz)	Antenna	Range	Max Value (dBm)	Limit (dBm)	Verdict
NVNT	a	5180	Ant1	30-1000	-43.72	-27	Pass
NVNT	a	5180	Ant1	1000-5000	-41.19	-27	Pass
NVNT	a	5180	Ant1	5000-40000	-33.91	-27	Pass
NVNT	a	5200	Ant1	30-1000	-43.13	-27	Pass
NVNT	a	5200	Ant1	1000-5000	-40.98	-27	Pass
NVNT	a	5200	Ant1	5000-40000	-34.14	-27	Pass
NVNT	a	5240	Ant1	30-1000	-44.18	-27	Pass
NVNT	a	5240	Ant1	1000-5000	-38.22	-27	Pass
NVNT	a	5240	Ant1	5000-40000	-34.07	-27	Pass
NVNT	a	5180	Ant2	30-1000	-43.73	-27	Pass
NVNT	a	5180	Ant2	1000-5000	-35.22	-27	Pass
NVNT	a	5180	Ant2	5000-40000	-33.63	-27	Pass
NVNT	a	5200	Ant2	30-1000	-44.12	-27	Pass
NVNT	a	5200	Ant2	1000-5000	-40.63	-27	Pass
NVNT	a	5200	Ant2	5000-40000	-33.64	-27	Pass
NVNT	a	5240	Ant2	30-1000	-43.41	-27	Pass
NVNT	a	5240	Ant2	1000-5000	-40.39	-27	Pass
NVNT	a	5240	Ant2	5000-40000	-34.04	-27	Pass
NVNT	a	5180	Ant1	30-1000	-43.8	-27	Pass
NVNT	a	5180	Ant1	1000-5000	-34.61	-27	Pass
NVNT	a	5180	Ant1	5000-40000	-33.81	-27	Pass
NVNT	a	5180	Ant2	30-1000	-44.31	-27	Pass
NVNT	a	5180	Ant2	1000-5000	-34.38	-27	Pass
NVNT	a	5180	Ant2	5000-40000	-34.33	-27	Pass
NVNT	a	5200	Ant1	30-1000	-43.06	-27	Pass
NVNT	a	5200	Ant1	1000-5000	-42.02	-27	Pass
NVNT	a	5200	Ant1	5000-40000	-34.39	-27	Pass
NVNT	a	5200	Ant2	30-1000	-43.6	-27	Pass
NVNT	a	5200	Ant2	1000-5000	-42.1	-27	Pass
NVNT	a	5200	Ant2	5000-40000	-34.43	-27	Pass
NVNT	a	5260	Ant1	30-1000	-44.15	-27	Pass
NVNT	a	5260	Ant1	1000-5000	-41.86	-27	Pass
NVNT	a	5260	Ant1	5000-40000	-35.03	-27	Pass
NVNT	a	5300	Ant1	30-1000	-43.59	-27	Pass
NVNT	a	5300	Ant1	1000-5000	-40.24	-27	Pass
NVNT	a	5300	Ant1	5000-40000	-34.52	-27	Pass
NVNT	a	5320	Ant1	30-1000	-43.78	-27	Pass
NVNT	a	5320	Ant1	1000-5000	-41.79	-27	Pass
NVNT	a	5320	Ant1	5000-40000	-33.48	-27	Pass
NVNT	a	5260	Ant2	30-1000	-43.92	-27	Pass



China

NVNT	a	5260	Ant2	1000-5000	-42.25	-27	Pass
NVNT	a	5260	Ant2	5000-40000	-34.48	-27	Pass
NVNT	a	5300	Ant2	30-1000	-44.01	-27	Pass
NVNT	a	5300	Ant2	1000-5000	-41.49	-27	Pass
NVNT	a	5300	Ant2	5000-40000	-34.66	-27	Pass
NVNT	a	5320	Ant2	30-1000	-44.31	-27	Pass
NVNT	a	5320	Ant2	1000-5000	-41.94	-27	Pass
NVNT	a	5320	Ant2	5000-40000	-33.79	-27	Pass
NVNT	a	5260	Ant1	30-1000	-44.02	-27	Pass
NVNT	a	5260	Ant1	1000-5000	-42.13	-27	Pass
NVNT	a	5260	Ant1	5000-40000	-34.69	-27	Pass
NVNT	a	5260	Ant2	30-1000	-44.37	-27	Pass
NVNT	a	5260	Ant2	1000-5000	-41.59	-27	Pass
NVNT	a	5260	Ant2	5000-40000	-34.28	-27	Pass
NVNT	a	5300	Ant1	30-1000	-43.48	-27	Pass
NVNT	a	5300	Ant1	1000-5000	-41.34	-27	Pass
NVNT	a	5300	Ant1	5000-40000	-34.53	-27	Pass
NVNT	a	5300	Ant2	30-1000	-44.28	-27	Pass
NVNT	a	5300	Ant2	1000-5000	-41.71	-27	Pass
NVNT	a	5300	Ant2	5000-40000	-34.53	-27	Pass
NVNT	a	5320	Ant1	30-1000	-44.16	-27	Pass
NVNT	a	5320	Ant1	1000-5000	-41.02	-27	Pass
NVNT	a	5320	Ant1	5000-40000	-34.71	-27	Pass
NVNT	a	5320	Ant2	30-1000	-44.01	-27	Pass
NVNT	a	5320	Ant2	1000-5000	-41.98	-27	Pass
NVNT	a	5320	Ant2	5000-40000	-34.54	-27	Pass
NVNT	a	5700	Ant2	30-1000	-44.15	-27	Pass
NVNT	a	5700	Ant2	1000-5000	-41.48	-27	Pass
NVNT	a	5700	Ant2	5000-40000	-33.92	-27	Pass
NVNT	a	5500	Ant1	30-1000	-44.01	-27	Pass
NVNT	a	5500	Ant1	1000-5000	-40.96	-27	Pass
NVNT	a	5500	Ant1	5000-40000	-33.25	-27	Pass
NVNT	a	5500	Ant2	30-1000	-44.1	-27	Pass
NVNT	a	5500	Ant2	1000-5000	-40.93	-27	Pass
NVNT	a	5500	Ant2	5000-40000	-34.42	-27	Pass
NVNT	a	5600	Ant1	30-1000	-43.52	-27	Pass
NVNT	a	5600	Ant1	1000-5000	-41.3	-27	Pass
NVNT	a	5600	Ant1	5000-40000	-34.65	-27	Pass
NVNT	a	5600	Ant2	30-1000	-43.46	-27	Pass
NVNT	a	5600	Ant2	1000-5000	-41.95	-27	Pass
NVNT	a	5600	Ant2	5000-40000	-34.04	-27	Pass
NVNT	a	5700	Ant1	30-1000	-44.21	-27	Pass



China

NVNT	a	5700	Ant1	1000-5000	-39.05	-27	Pass
NVNT	a	5700	Ant1	5000-40000	-34.19	-27	Pass
NVNT	a	5700	Ant2	30-1000	-43.82	-27	Pass
NVNT	a	5700	Ant2	1000-5000	-40.24	-27	Pass
NVNT	a	5700	Ant2	5000-40000	-34.3	-27	Pass
NVNT	a	5720	Ant1	30-1000	-43.89	-27	Pass
NVNT	a	5720	Ant1	1000-5000	-41.75	-27	Pass
NVNT	a	5720	Ant1	5000-40000	-33.99	-27	Pass
NVNT	a	5720	Ant2	30-1000	-44.16	-27	Pass
NVNT	a	5720	Ant2	1000-5000	-41.76	-27	Pass
NVNT	a	5720	Ant2	5000-40000	-34.52	-27	Pass
NVNT	a	5745	Ant1	30-1000	-43.43	-27	Pass
NVNT	a	5745	Ant1	1000-5000	-41.82	-27	Pass
NVNT	a	5745	Ant1	5000-40000	-33.99	-27	Pass
NVNT	a	5745	Ant2	30-1000	-43.42	-27	Pass
NVNT	a	5745	Ant2	1000-5000	-41.89	-27	Pass
NVNT	a	5745	Ant2	5000-40000	-34.6	-27	Pass
NVNT	a	5785	Ant1	30-1000	-44.08	-27	Pass
NVNT	a	5785	Ant1	1000-5000	-41.58	-27	Pass
NVNT	a	5785	Ant1	5000-40000	-33.86	-27	Pass
NVNT	a	5785	Ant2	30-1000	-43.81	-27	Pass
NVNT	a	5785	Ant2	1000-5000	-41.82	-27	Pass
NVNT	a	5785	Ant2	5000-40000	-34.06	-27	Pass
NVNT	a	5825	Ant1	30-1000	-43.53	-27	Pass
NVNT	a	5825	Ant1	1000-5000	-38.27	-27	Pass
NVNT	a	5825	Ant1	5000-40000	-34.33	-27	Pass
NVNT	a	5825	Ant2	30-1000	-43.54	-27	Pass
NVNT	a	5825	Ant2	1000-5000	-33.93	-27	Pass
NVNT	a	5825	Ant2	5000-40000	-33.94	-27	Pass
NVNT	n20	5180	Ant1	30-1000	-43.86	-27	Pass
NVNT	n20	5180	Ant1	1000-5000	-32.47	-27	Pass
NVNT	n20	5180	Ant1	5000-40000	-33.83	-27	Pass
NVNT	n20	5200	Ant1	30-1000	-43.78	-27	Pass
NVNT	n20	5200	Ant1	1000-5000	-36.73	-27	Pass
NVNT	n20	5200	Ant1	5000-40000	-34.42	-27	Pass
NVNT	n20	5240	Ant1	30-1000	-43.69	-27	Pass
NVNT	n20	5240	Ant1	1000-5000	-38.52	-27	Pass
NVNT	n20	5240	Ant1	5000-40000	-34.28	-27	Pass
NVNT	n20	5180	Ant2	30-1000	-43.77	-27	Pass
NVNT	n20	5180	Ant2	1000-5000	-40.94	-27	Pass
NVNT	n20	5180	Ant2	5000-40000	-34.27	-27	Pass
NVNT	n20	5200	Ant2	30-1000	-43.31	-27	Pass



China

NVNT	n20	5200	Ant2	1000-5000	-37.34	-27	Pass
NVNT	n20	5200	Ant2	5000-40000	-33.9	-27	Pass
NVNT	n20	5240	Ant2	30-1000	-43.74	-27	Pass
NVNT	n20	5240	Ant2	1000-5000	-38.22	-27	Pass
NVNT	n20	5240	Ant2	5000-40000	-34.45	-27	Pass
NVNT	n20	5260	Ant1	30-1000	-44.11	-27	Pass
NVNT	n20	5260	Ant1	1000-5000	-41.09	-27	Pass
NVNT	n20	5260	Ant1	5000-40000	-34.33	-27	Pass
NVNT	n20	5300	Ant1	30-1000	-43.86	-27	Pass
NVNT	n20	5300	Ant1	1000-5000	-41.64	-27	Pass
NVNT	n20	5300	Ant1	5000-40000	-34.04	-27	Pass
NVNT	n20	5320	Ant1	30-1000	-44.13	-27	Pass
NVNT	n20	5320	Ant1	1000-5000	-41.49	-27	Pass
NVNT	n20	5320	Ant1	5000-40000	-33.92	-27	Pass
NVNT	n20	5260	Ant2	30-1000	-43.85	-27	Pass
NVNT	n20	5260	Ant2	1000-5000	-42.02	-27	Pass
NVNT	n20	5260	Ant2	5000-40000	-34.48	-27	Pass
NVNT	n20	5300	Ant2	30-1000	-43.89	-27	Pass
NVNT	n20	5300	Ant2	1000-5000	-41.67	-27	Pass
NVNT	n20	5300	Ant2	5000-40000	-33.93	-27	Pass
NVNT	n20	5320	Ant2	30-1000	-43.81	-27	Pass
NVNT	n20	5320	Ant2	1000-5000	-41.25	-27	Pass
NVNT	n20	5320	Ant2	5000-40000	-34.3	-27	Pass
NVNT	n20	5500	Ant1	30-1000	-42.49	-27	Pass
NVNT	n20	5500	Ant1	1000-5000	-38.91	-27	Pass
NVNT	n20	5500	Ant1	5000-40000	-32.25	-27	Pass
NVNT	n20	5600	Ant1	30-1000	-42.39	-27	Pass
NVNT	n20	5600	Ant1	1000-5000	-39.66	-27	Pass
NVNT	n20	5600	Ant1	5000-40000	-31.25	-27	Pass
NVNT	n20	5700	Ant1	30-1000	-42.09	-27	Pass
NVNT	n20	5700	Ant1	1000-5000	-40.01	-27	Pass
NVNT	n20	5700	Ant1	5000-40000	-32.91	-27	Pass
NVNT	n20	5500	Ant2	30-1000	-42.33	-27	Pass
NVNT	n20	5500	Ant2	1000-5000	-39.9	-27	Pass
NVNT	n20	5500	Ant2	5000-40000	-32.26	-27	Pass
NVNT	n20	5600	Ant2	30-1000	-42.58	-27	Pass
NVNT	n20	5600	Ant2	1000-5000	-40.14	-27	Pass
NVNT	n20	5600	Ant2	5000-40000	-32.12	-27	Pass
NVNT	n20	5700	Ant2	30-1000	-42.35	-27	Pass
NVNT	n20	5700	Ant2	1000-5000	-40.33	-27	Pass
NVNT	n20	5700	Ant2	5000-40000	-32.24	-27	Pass
NVNT	n20	5720	Ant1	30-1000	-42.22	-27	Pass



China

NVNT	n20	5720	Ant1	1000-5000	-39.95	-27	Pass
NVNT	n20	5720	Ant1	5000-40000	-32.73	-27	Pass
NVNT	n20	5720	Ant2	30-1000	-42.8	-27	Pass
NVNT	n20	5720	Ant2	1000-5000	-40.2	-27	Pass
NVNT	n20	5720	Ant2	5000-40000	-32.8	-27	Pass
NVNT	n20	5745	Ant1	30-1000	-42.32	-27	Pass
NVNT	n20	5745	Ant1	1000-5000	-38.53	-27	Pass
NVNT	n20	5745	Ant1	5000-40000	-32.64	-27	Pass
NVNT	n20	5785	Ant1	30-1000	-42.12	-27	Pass
NVNT	n20	5785	Ant1	1000-5000	-39.68	-27	Pass
NVNT	n20	5785	Ant1	5000-40000	-32.84	-27	Pass
NVNT	n20	5825	Ant1	30-1000	-42.04	-27	Pass
NVNT	n20	5825	Ant1	1000-5000	-40.18	-27	Pass
NVNT	n20	5825	Ant1	5000-40000	-31.97	-27	Pass
NVNT	n20	5745	Ant2	30-1000	-41.58	-27	Pass
NVNT	n20	5745	Ant2	1000-5000	-39.67	-27	Pass
NVNT	n20	5745	Ant2	5000-40000	-32.34	-27	Pass
NVNT	n20	5785	Ant2	30-1000	-41.53	-27	Pass
NVNT	n20	5785	Ant2	1000-5000	-40.07	-27	Pass
NVNT	n20	5785	Ant2	5000-40000	-31.99	-27	Pass
NVNT	n20	5825	Ant2	30-1000	-42.22	-27	Pass
NVNT	n20	5825	Ant2	1000-5000	-40.3	-27	Pass
NVNT	n20	5825	Ant2	5000-40000	-32.72	-27	Pass
NVNT	n40	5190	Ant1	30-1000	-43.94	-27	Pass
NVNT	n40	5190	Ant1	1000-5000	-41.69	-27	Pass
NVNT	n40	5190	Ant1	5000-40000	-34.3	-27	Pass
NVNT	n40	5230	Ant1	30-1000	-43.55	-27	Pass
NVNT	n40	5230	Ant1	1000-5000	-29.21	-27	Pass
NVNT	n40	5230	Ant1	5000-40000	-34.25	-27	Pass
NVNT	n40	5190	Ant2	30-1000	-43.75	-27	Pass
NVNT	n40	5190	Ant2	1000-5000	-40.47	-27	Pass
NVNT	n40	5190	Ant2	5000-40000	-34.22	-27	Pass
NVNT	n40	5230	Ant2	30-1000	-44.39	-27	Pass
NVNT	n40	5230	Ant2	1000-5000	-42.2	-27	Pass
NVNT	n40	5230	Ant2	5000-40000	-33.72	-27	Pass
NVNT	n40	5270	Ant1	30-1000	-43.08	-27	Pass
NVNT	n40	5270	Ant1	1000-5000	-41.37	-27	Pass
NVNT	n40	5270	Ant1	5000-40000	-34.11	-27	Pass
NVNT	n40	5310	Ant1	30-1000	-44.12	-27	Pass
NVNT	n40	5310	Ant1	1000-5000	-31.87	-27	Pass
NVNT	n40	5310	Ant1	5000-40000	-34.33	-27	Pass
NVNT	n40	5270	Ant2	30-1000	-44.08	-27	Pass



China

NVNT	n40	5270	Ant2	1000-5000	-41.58	-27	Pass
NVNT	n40	5270	Ant2	5000-40000	-33.53	-27	Pass
NVNT	n40	5310	Ant2	30-1000	-43.58	-27	Pass
NVNT	n40	5310	Ant2	1000-5000	-35.62	-27	Pass
NVNT	n40	5310	Ant2	5000-40000	-34.01	-27	Pass
NVNT	n40	5510	Ant1	30-1000	-42.38	-27	Pass
NVNT	n40	5510	Ant1	1000-5000	-40.35	-27	Pass
NVNT	n40	5510	Ant1	5000-40000	-31.93	-27	Pass
NVNT	n40	5590	Ant1	30-1000	-42.04	-27	Pass
NVNT	n40	5590	Ant1	1000-5000	-40.22	-27	Pass
NVNT	n40	5590	Ant1	5000-40000	-32.29	-27	Pass
NVNT	n40	5670	Ant1	30-1000	-42.37	-27	Pass
NVNT	n40	5670	Ant1	1000-5000	-40.09	-27	Pass
NVNT	n40	5670	Ant1	5000-40000	-32.19	-27	Pass
NVNT	n40	5510	Ant2	30-1000	-41.84	-27	Pass
NVNT	n40	5510	Ant2	1000-5000	-40.15	-27	Pass
NVNT	n40	5510	Ant2	5000-40000	-31.98	-27	Pass
NVNT	n40	5590	Ant2	30-1000	-42.35	-27	Pass
NVNT	n40	5590	Ant2	1000-5000	-39.75	-27	Pass
NVNT	n40	5590	Ant2	5000-40000	-31.87	-27	Pass
NVNT	n40	5670	Ant2	30-1000	-42.35	-27	Pass
NVNT	n40	5670	Ant2	1000-5000	-39.89	-27	Pass
NVNT	n40	5670	Ant2	5000-40000	-32.62	-27	Pass
NVNT	n40	5710	Ant1	30-1000	-41.84	-27	Pass
NVNT	n40	5710	Ant1	1000-5000	-39.89	-27	Pass
NVNT	n40	5710	Ant1	5000-40000	-31.35	-27	Pass
NVNT	n40	5710	Ant2	30-1000	-41.98	-27	Pass
NVNT	n40	5710	Ant2	1000-5000	-39.61	-27	Pass
NVNT	n40	5710	Ant2	5000-40000	-31.6	-27	Pass
NVNT	n40	5755	Ant1	30-1000	-42.13	-27	Pass
NVNT	n40	5755	Ant1	1000-5000	-39.75	-27	Pass
NVNT	n40	5755	Ant1	5000-40000	-32.39	-27	Pass
NVNT	n40	5795	Ant1	30-1000	-42.57	-27	Pass
NVNT	n40	5795	Ant1	1000-5000	-40.68	-27	Pass
NVNT	n40	5795	Ant1	5000-40000	-32.71	-27	Pass
NVNT	n40	5755	Ant2	30-1000	-42.29	-27	Pass
NVNT	n40	5755	Ant2	1000-5000	-36.59	-27	Pass
NVNT	n40	5755	Ant2	5000-40000	-32.84	-27	Pass
NVNT	n40	5795	Ant2	30-1000	-42.5	-27	Pass
NVNT	n40	5795	Ant2	1000-5000	-39.99	-27	Pass
NVNT	n40	5795	Ant2	5000-40000	-31.8	-27	Pass
NVNT	ac20	5180	Ant1	30-1000	-43.92	-27	Pass



China

NVNT	ac20	5180	Ant1	1000-5000	-41.85	-27	Pass
NVNT	ac20	5180	Ant1	5000-40000	-34.17	-27	Pass
NVNT	ac20	5200	Ant1	30-1000	-44.04	-27	Pass
NVNT	ac20	5200	Ant1	1000-5000	-33.68	-27	Pass
NVNT	ac20	5200	Ant1	5000-40000	-33.83	-27	Pass
NVNT	ac20	5240	Ant1	30-1000	-43.14	-27	Pass
NVNT	ac20	5240	Ant1	1000-5000	-41.92	-27	Pass
NVNT	ac20	5240	Ant1	5000-40000	-34.38	-27	Pass
NVNT	ac20	5180	Ant2	30-1000	-43.89	-27	Pass
NVNT	ac20	5180	Ant2	1000-5000	-41.95	-27	Pass
NVNT	ac20	5180	Ant2	5000-40000	-33.5	-27	Pass
NVNT	ac20	5200	Ant2	30-1000	-43.83	-27	Pass
NVNT	ac20	5200	Ant2	1000-5000	-36.95	-27	Pass
NVNT	ac20	5200	Ant2	5000-40000	-34.01	-27	Pass
NVNT	ac20	5240	Ant2	30-1000	-43.8	-27	Pass
NVNT	ac20	5240	Ant2	1000-5000	-40.65	-27	Pass
NVNT	ac20	5240	Ant2	5000-40000	-34.68	-27	Pass
NVNT	ac20	5260	Ant1	30-1000	-43.81	-27	Pass
NVNT	ac20	5260	Ant1	1000-5000	-41.64	-27	Pass
NVNT	ac20	5260	Ant1	5000-40000	-33.39	-27	Pass
NVNT	ac20	5300	Ant1	30-1000	-44	-27	Pass
NVNT	ac20	5300	Ant1	1000-5000	-41.67	-27	Pass
NVNT	ac20	5300	Ant1	5000-40000	-34.46	-27	Pass
NVNT	ac20	5320	Ant1	30-1000	-43.71	-27	Pass
NVNT	ac20	5320	Ant1	1000-5000	-41.1	-27	Pass
NVNT	ac20	5320	Ant1	5000-40000	-33.48	-27	Pass
NVNT	ac20	5260	Ant2	30-1000	-44	-27	Pass
NVNT	ac20	5260	Ant2	1000-5000	-38.37	-27	Pass
NVNT	ac20	5260	Ant2	5000-40000	-33.02	-27	Pass
NVNT	ac20	5300	Ant2	30-1000	-44.2	-27	Pass
NVNT	ac20	5300	Ant2	1000-5000	-41.77	-27	Pass
NVNT	ac20	5300	Ant2	5000-40000	-34.45	-27	Pass
NVNT	ac20	5320	Ant2	30-1000	-40.02	-27	Pass
NVNT	ac20	5320	Ant2	1000-5000	-41.73	-27	Pass
NVNT	ac20	5320	Ant2	5000-40000	-34.14	-27	Pass
NVNT	ac20	5500	Ant1	30-1000	-42.1	-27	Pass
NVNT	ac20	5500	Ant1	1000-5000	-39.8	-27	Pass
NVNT	ac20	5500	Ant1	5000-40000	-32.7	-27	Pass
NVNT	ac20	5600	Ant1	30-1000	-42.65	-27	Pass
NVNT	ac20	5600	Ant1	1000-5000	-40.21	-27	Pass
NVNT	ac20	5600	Ant1	5000-40000	-32.33	-27	Pass
NVNT	ac20	5700	Ant1	30-1000	-42.16	-27	Pass



China

NVNT	ac20	5700	Ant1	1000-5000	-40.59	-27	Pass
NVNT	ac20	5700	Ant1	5000-40000	-33.17	-27	Pass
NVNT	ac20	5500	Ant2	30-1000	-42.41	-27	Pass
NVNT	ac20	5500	Ant2	1000-5000	-40.17	-27	Pass
NVNT	ac20	5500	Ant2	5000-40000	-32.16	-27	Pass
NVNT	ac20	5600	Ant2	30-1000	-41.63	-27	Pass
NVNT	ac20	5600	Ant2	1000-5000	-39.78	-27	Pass
NVNT	ac20	5600	Ant2	5000-40000	-32.26	-27	Pass
NVNT	ac20	5700	Ant2	30-1000	-41.79	-27	Pass
NVNT	ac20	5700	Ant2	1000-5000	-40.07	-27	Pass
NVNT	ac20	5700	Ant2	5000-40000	-31.54	-27	Pass
NVNT	ac20	5720	Ant1	30-1000	-42.21	-27	Pass
NVNT	ac20	5720	Ant1	1000-5000	-39.63	-27	Pass
NVNT	ac20	5720	Ant1	5000-40000	-32.22	-27	Pass
NVNT	ac20	5720	Ant2	30-1000	-42.39	-27	Pass
NVNT	ac20	5720	Ant2	1000-5000	-39.69	-27	Pass
NVNT	ac20	5720	Ant2	5000-40000	-32.74	-27	Pass
NVNT	ac20	5745	Ant1	30-1000	-42.51	-27	Pass
NVNT	ac20	5745	Ant1	1000-5000	-39.63	-27	Pass
NVNT	ac20	5745	Ant1	5000-40000	-32.69	-27	Pass
NVNT	ac20	5785	Ant1	30-1000	-42.46	-27	Pass
NVNT	ac20	5785	Ant1	1000-5000	-40.45	-27	Pass
NVNT	ac20	5785	Ant1	5000-40000	-32.08	-27	Pass
NVNT	ac20	5825	Ant1	30-1000	-42.28	-27	Pass
NVNT	ac20	5825	Ant1	1000-5000	-40.34	-27	Pass
NVNT	ac20	5825	Ant1	5000-40000	-32.39	-27	Pass
NVNT	ac20	5745	Ant2	30-1000	-42.79	-27	Pass
NVNT	ac20	5745	Ant2	1000-5000	-39.54	-27	Pass
NVNT	ac20	5745	Ant2	5000-40000	-32.3	-27	Pass
NVNT	ac20	5785	Ant2	30-1000	-42.4	-27	Pass
NVNT	ac20	5785	Ant2	1000-5000	-40.41	-27	Pass
NVNT	ac20	5785	Ant2	5000-40000	-32.87	-27	Pass
NVNT	ac20	5825	Ant2	30-1000	-42.04	-27	Pass
NVNT	ac20	5825	Ant2	1000-5000	-40.12	-27	Pass
NVNT	ac20	5825	Ant2	5000-40000	-31.97	-27	Pass
NVNT	ac40	5190	Ant1	30-1000	-44.25	-27	Pass
NVNT	ac40	5190	Ant1	1000-5000	-41.84	-27	Pass
NVNT	ac40	5190	Ant1	5000-40000	-34.32	-27	Pass
NVNT	ac40	5230	Ant1	30-1000	-44.12	-27	Pass
NVNT	ac40	5230	Ant1	1000-5000	-41.25	-27	Pass
NVNT	ac40	5230	Ant1	5000-40000	-34.41	-27	Pass
NVNT	ac40	5190	Ant2	30-1000	-43.9	-27	Pass



China

NVNT	ac40	5190	Ant2	1000-5000	-41.62	-27	Pass
NVNT	ac40	5190	Ant2	5000-40000	-33.24	-27	Pass
NVNT	ac40	5230	Ant2	30-1000	-43.68	-27	Pass
NVNT	ac40	5230	Ant2	1000-5000	-31.76	-27	Pass
NVNT	ac40	5230	Ant2	5000-40000	-34.3	-27	Pass
NVNT	ac40	5270	Ant1	30-1000	-44.37	-27	Pass
NVNT	ac40	5270	Ant1	1000-5000	-42.1	-27	Pass
NVNT	ac40	5270	Ant1	5000-40000	-34.28	-27	Pass
NVNT	ac40	5310	Ant1	30-1000	-43.87	-27	Pass
NVNT	ac40	5310	Ant1	1000-5000	-42.13	-27	Pass
NVNT	ac40	5310	Ant1	5000-40000	-34.09	-27	Pass
NVNT	ac40	5270	Ant2	30-1000	-44.2	-27	Pass
NVNT	ac40	5270	Ant2	1000-5000	-36.83	-27	Pass
NVNT	ac40	5270	Ant2	5000-40000	-34.05	-27	Pass
NVNT	ac40	5310	Ant2	30-1000	-43.61	-27	Pass
NVNT	ac40	5310	Ant2	1000-5000	-38.29	-27	Pass
NVNT	ac40	5310	Ant2	5000-40000	-34.53	-27	Pass
NVNT	ac40	5510	Ant1	30-1000	-42.29	-27	Pass
NVNT	ac40	5510	Ant1	1000-5000	-39.82	-27	Pass
NVNT	ac40	5510	Ant1	5000-40000	-32.87	-27	Pass
NVNT	ac40	5590	Ant1	30-1000	-42.6	-27	Pass
NVNT	ac40	5590	Ant1	1000-5000	-40.29	-27	Pass
NVNT	ac40	5590	Ant1	5000-40000	-32.41	-27	Pass
NVNT	ac40	5670	Ant1	30-1000	-42.5	-27	Pass
NVNT	ac40	5670	Ant1	1000-5000	-39.54	-27	Pass
NVNT	ac40	5670	Ant1	5000-40000	-32.68	-27	Pass
NVNT	ac40	5510	Ant2	30-1000	-42.77	-27	Pass
NVNT	ac40	5510	Ant2	1000-5000	-39.12	-27	Pass
NVNT	ac40	5510	Ant2	5000-40000	-32.27	-27	Pass
NVNT	ac40	5590	Ant2	30-1000	-42.06	-27	Pass
NVNT	ac40	5590	Ant2	1000-5000	-40.03	-27	Pass
NVNT	ac40	5590	Ant2	5000-40000	-32.54	-27	Pass
NVNT	ac40	5670	Ant2	30-1000	-42.29	-27	Pass
NVNT	ac40	5670	Ant2	1000-5000	-39.04	-27	Pass
NVNT	ac40	5670	Ant2	5000-40000	-32.57	-27	Pass
NVNT	ac40	5710	Ant1	30-1000	-42.49	-27	Pass
NVNT	ac40	5710	Ant1	1000-5000	-40.02	-27	Pass
NVNT	ac40	5710	Ant1	5000-40000	-32.28	-27	Pass
NVNT	ac40	5710	Ant2	30-1000	-42.48	-27	Pass
NVNT	ac40	5710	Ant2	1000-5000	-40.03	-27	Pass
NVNT	ac40	5710	Ant2	5000-40000	-32.04	-27	Pass
NVNT	ac40	5755	Ant1	30-1000	-42.28	-27	Pass



China

NVNT	ac40	5755	Ant1	1000-5000	-38.88	-27	Pass
NVNT	ac40	5755	Ant1	5000-40000	-31.95	-27	Pass
NVNT	ac40	5795	Ant1	30-1000	-42.47	-27	Pass
NVNT	ac40	5795	Ant1	1000-5000	-39.86	-27	Pass
NVNT	ac40	5795	Ant1	5000-40000	-32.56	-27	Pass
NVNT	ac40	5755	Ant2	30-1000	-42.18	-27	Pass
NVNT	ac40	5755	Ant2	1000-5000	-40.25	-27	Pass
NVNT	ac40	5755	Ant2	5000-40000	-32.63	-27	Pass
NVNT	ac40	5795	Ant2	30-1000	-42.38	-27	Pass
NVNT	ac40	5795	Ant2	1000-5000	-40.21	-27	Pass
NVNT	ac40	5795	Ant2	5000-40000	-33.13	-27	Pass
NVNT	ac80	5210	Ant1	30-1000	-44.02	-27	Pass
NVNT	ac80	5210	Ant1	1000-5000	-41.25	-27	Pass
NVNT	ac80	5210	Ant1	5000-40000	-33.21	-27	Pass
NVNT	ac80	5210	Ant2	30-1000	-44.04	-27	Pass
NVNT	ac80	5210	Ant2	1000-5000	-37.85	-27	Pass
NVNT	ac80	5210	Ant2	5000-40000	-34.96	-27	Pass
NVNT	ac80	5290	Ant1	30-1000	-44.4	-27	Pass
NVNT	ac80	5290	Ant1	1000-5000	-41.86	-27	Pass
NVNT	ac80	5290	Ant1	5000-40000	-34.43	-27	Pass
NVNT	ac80	5290	Ant2	30-1000	-43.31	-27	Pass
NVNT	ac80	5290	Ant2	1000-5000	-41.51	-27	Pass
NVNT	ac80	5290	Ant2	5000-40000	-34.65	-27	Pass
NVNT	ac80	5530	Ant1	30-1000	-42.67	-27	Pass
NVNT	ac80	5530	Ant1	1000-5000	-39.86	-27	Pass
NVNT	ac80	5530	Ant1	5000-40000	-32.92	-27	Pass
NVNT	ac80	5610	Ant1	30-1000	-41.9	-27	Pass
NVNT	ac80	5610	Ant1	1000-5000	-40.33	-27	Pass
NVNT	ac80	5610	Ant1	5000-40000	-31.95	-27	Pass
NVNT	ac80	5530	Ant2	30-1000	-42.12	-27	Pass
NVNT	ac80	5530	Ant2	1000-5000	-40.73	-27	Pass
NVNT	ac80	5530	Ant2	5000-40000	-32.22	-27	Pass
NVNT	ac80	5610	Ant2	30-1000	-41.74	-27	Pass
NVNT	ac80	5610	Ant2	1000-5000	-39.82	-27	Pass
NVNT	ac80	5610	Ant2	5000-40000	-32.29	-27	Pass
NVNT	ac80	5690	Ant1	30-1000	-42.23	-27	Pass
NVNT	ac80	5690	Ant1	1000-5000	-38.94	-27	Pass
NVNT	ac80	5690	Ant1	5000-40000	-32.43	-27	Pass
NVNT	ac80	5690	Ant2	30-1000	-41.83	-27	Pass
NVNT	ac80	5690	Ant2	1000-5000	-40.11	-27	Pass
NVNT	ac80	5690	Ant2	5000-40000	-32.28	-27	Pass
NVNT	ac80	5775	Ant1	30-1000	-42.07	-27	Pass



China

NVNT	ac80	5775	Ant1	1000-5000	-40.03	-27	Pass
NVNT	ac80	5775	Ant1	5000-40000	-32.75	-27	Pass
NVNT	ac80	5775	Ant2	30-1000	-41.39	-27	Pass
NVNT	ac80	5775	Ant2	1000-5000	-40.35	-27	Pass
NVNT	ac80	5775	Ant2	5000-40000	-32.65	-27	Pass
NVNT	ax20	5180	Ant1	30-1000	-43.9	-27	Pass
NVNT	ax20	5180	Ant1	1000-5000	-41.87	-27	Pass
NVNT	ax20	5180	Ant1	5000-40000	-33.76	-27	Pass
NVNT	ax20	5200	Ant1	30-1000	-43.53	-27	Pass
NVNT	ax20	5200	Ant1	1000-5000	-37.28	-27	Pass
NVNT	ax20	5200	Ant1	5000-40000	-33.78	-27	Pass
NVNT	ax20	5240	Ant1	30-1000	-44.1	-27	Pass
NVNT	ax20	5240	Ant1	1000-5000	-41.93	-27	Pass
NVNT	ax20	5240	Ant1	5000-40000	-34.19	-27	Pass
NVNT	ax20	5180	Ant2	30-1000	-43.82	-27	Pass
NVNT	ax20	5180	Ant2	1000-5000	-38.62	-27	Pass
NVNT	ax20	5180	Ant2	5000-40000	-34.19	-27	Pass
NVNT	ax20	5200	Ant2	30-1000	-43.41	-27	Pass
NVNT	ax20	5200	Ant2	1000-5000	-40.08	-27	Pass
NVNT	ax20	5200	Ant2	5000-40000	-34.74	-27	Pass
NVNT	ax20	5240	Ant2	30-1000	-43.91	-27	Pass
NVNT	ax20	5240	Ant2	1000-5000	-39.53	-27	Pass
NVNT	ax20	5240	Ant2	5000-40000	-34.51	-27	Pass
NVNT	ax20	5260	Ant1	30-1000	-44.1	-27	Pass
NVNT	ax20	5260	Ant1	1000-5000	-41.85	-27	Pass
NVNT	ax20	5260	Ant1	5000-40000	-34.2	-27	Pass
NVNT	ax20	5300	Ant1	30-1000	-43.81	-27	Pass
NVNT	ax20	5300	Ant1	1000-5000	-31.52	-27	Pass
NVNT	ax20	5300	Ant1	5000-40000	-33.92	-27	Pass
NVNT	ax20	5320	Ant1	30-1000	-44.31	-27	Pass
NVNT	ax20	5320	Ant1	1000-5000	-37.01	-27	Pass
NVNT	ax20	5320	Ant1	5000-40000	-33.71	-27	Pass
NVNT	ax20	5260	Ant2	30-1000	-43.95	-27	Pass
NVNT	ax20	5260	Ant2	1000-5000	-39.79	-27	Pass
NVNT	ax20	5260	Ant2	5000-40000	-34.28	-27	Pass
NVNT	ax20	5300	Ant2	30-1000	-43.12	-27	Pass
NVNT	ax20	5300	Ant2	1000-5000	-42.11	-27	Pass
NVNT	ax20	5300	Ant2	5000-40000	-34.18	-27	Pass
NVNT	ax20	5320	Ant2	30-1000	-42.62	-27	Pass
NVNT	ax20	5320	Ant2	1000-5000	-41.61	-27	Pass
NVNT	ax20	5320	Ant2	5000-40000	-33.95	-27	Pass
NVNT	ax20	5500	Ant1	30-1000	-42.3	-27	Pass



China

NVNT	ax20	5500	Ant1	1000-5000	-39.49	-27	Pass
NVNT	ax20	5500	Ant1	5000-40000	-32.97	-27	Pass
NVNT	ax20	5600	Ant1	30-1000	-41.81	-27	Pass
NVNT	ax20	5600	Ant1	1000-5000	-39.97	-27	Pass
NVNT	ax20	5600	Ant1	5000-40000	-32.76	-27	Pass
NVNT	ax20	5700	Ant1	30-1000	-42.72	-27	Pass
NVNT	ax20	5700	Ant1	1000-5000	-39.14	-27	Pass
NVNT	ax20	5700	Ant1	5000-40000	-32.48	-27	Pass
NVNT	ax20	5500	Ant2	30-1000	-42.08	-27	Pass
NVNT	ax20	5500	Ant2	1000-5000	-40.18	-27	Pass
NVNT	ax20	5500	Ant2	5000-40000	-32.45	-27	Pass
NVNT	ax20	5600	Ant2	30-1000	-41.98	-27	Pass
NVNT	ax20	5600	Ant2	1000-5000	-39.97	-27	Pass
NVNT	ax20	5600	Ant2	5000-40000	-32.06	-27	Pass
NVNT	ax20	5700	Ant2	30-1000	-41.99	-27	Pass
NVNT	ax20	5700	Ant2	1000-5000	-40.38	-27	Pass
NVNT	ax20	5700	Ant2	5000-40000	-31.28	-27	Pass
NVNT	ax20	5720	Ant1	30-1000	-41.94	-27	Pass
NVNT	ax20	5720	Ant1	1000-5000	-39.76	-27	Pass
NVNT	ax20	5720	Ant1	5000-40000	-32.35	-27	Pass
NVNT	ax20	5720	Ant2	30-1000	-42.46	-27	Pass
NVNT	ax20	5720	Ant2	1000-5000	-40.26	-27	Pass
NVNT	ax20	5720	Ant2	5000-40000	-32.28	-27	Pass
NVNT	ax20	5745	Ant1	30-1000	-42.66	-27	Pass
NVNT	ax20	5745	Ant1	1000-5000	-40.27	-27	Pass
NVNT	ax20	5745	Ant1	5000-40000	-31.45	-27	Pass
NVNT	ax20	5785	Ant1	30-1000	-41.95	-27	Pass
NVNT	ax20	5785	Ant1	1000-5000	-39.68	-27	Pass
NVNT	ax20	5785	Ant1	5000-40000	-33.12	-27	Pass
NVNT	ax20	5825	Ant1	30-1000	-41.85	-27	Pass
NVNT	ax20	5825	Ant1	1000-5000	-40.23	-27	Pass
NVNT	ax20	5825	Ant1	5000-40000	-32.09	-27	Pass
NVNT	ax20	5745	Ant2	30-1000	-42.27	-27	Pass
NVNT	ax20	5745	Ant2	1000-5000	-39.7	-27	Pass
NVNT	ax20	5745	Ant2	5000-40000	-28.58	-27	Pass
NVNT	ax20	5785	Ant2	30-1000	-41.73	-27	Pass
NVNT	ax20	5785	Ant2	1000-5000	-39.91	-27	Pass
NVNT	ax20	5785	Ant2	5000-40000	-32.45	-27	Pass
NVNT	ax20	5825	Ant2	30-1000	-42.65	-27	Pass
NVNT	ax20	5825	Ant2	1000-5000	-40.34	-27	Pass
NVNT	ax20	5825	Ant2	5000-40000	-31.9	-27	Pass
NVNT	ax40	5190	Ant1	30-1000	-43.38	-27	Pass



China

NVNT	ax40	5190	Ant1	1000-5000	-41.75	-27	Pass
NVNT	ax40	5190	Ant1	5000-40000	-34.38	-27	Pass
NVNT	ax40	5230	Ant1	30-1000	-43.89	-27	Pass
NVNT	ax40	5230	Ant1	1000-5000	-41.6	-27	Pass
NVNT	ax40	5230	Ant1	5000-40000	-34.39	-27	Pass
NVNT	ax40	5190	Ant2	30-1000	-43.96	-27	Pass
NVNT	ax40	5190	Ant2	1000-5000	-34.13	-27	Pass
NVNT	ax40	5190	Ant2	5000-40000	-34.03	-27	Pass
NVNT	ax40	5230	Ant2	30-1000	-43.88	-27	Pass
NVNT	ax40	5230	Ant2	1000-5000	-29	-27	Pass
NVNT	ax40	5230	Ant2	5000-40000	-34.05	-27	Pass
NVNT	ax40	5270	Ant1	30-1000	-43.94	-27	Pass
NVNT	ax40	5270	Ant1	1000-5000	-41.88	-27	Pass
NVNT	ax40	5270	Ant1	5000-40000	-34.62	-27	Pass
NVNT	ax40	5310	Ant1	30-1000	-43.59	-27	Pass
NVNT	ax40	5310	Ant1	1000-5000	-41.1	-27	Pass
NVNT	ax40	5310	Ant1	5000-40000	-34.01	-27	Pass
NVNT	ax40	5270	Ant2	30-1000	-44.33	-27	Pass
NVNT	ax40	5270	Ant2	1000-5000	-41.53	-27	Pass
NVNT	ax40	5270	Ant2	5000-40000	-34.56	-27	Pass
NVNT	ax40	5310	Ant2	30-1000	-44.14	-27	Pass
NVNT	ax40	5310	Ant2	1000-5000	-41.97	-27	Pass
NVNT	ax40	5310	Ant2	5000-40000	-34.24	-27	Pass
NVNT	ax40	5510	Ant1	30-1000	-41.74	-27	Pass
NVNT	ax40	5510	Ant1	1000-5000	-40.29	-27	Pass
NVNT	ax40	5510	Ant1	5000-40000	-31.75	-27	Pass
NVNT	ax40	5590	Ant1	30-1000	-42.47	-27	Pass
NVNT	ax40	5590	Ant1	1000-5000	-40.24	-27	Pass
NVNT	ax40	5590	Ant1	5000-40000	-32	-27	Pass
NVNT	ax40	5670	Ant1	30-1000	-41.86	-27	Pass
NVNT	ax40	5670	Ant1	1000-5000	-40.05	-27	Pass
NVNT	ax40	5670	Ant1	5000-40000	-32.37	-27	Pass
NVNT	ax40	5510	Ant2	30-1000	-42.05	-27	Pass
NVNT	ax40	5510	Ant2	1000-5000	-39.8	-27	Pass
NVNT	ax40	5510	Ant2	5000-40000	-32.81	-27	Pass
NVNT	ax40	5590	Ant2	30-1000	-42.15	-27	Pass
NVNT	ax40	5590	Ant2	1000-5000	-40.26	-27	Pass
NVNT	ax40	5590	Ant2	5000-40000	-32.09	-27	Pass
NVNT	ax40	5670	Ant2	30-1000	-42.01	-27	Pass
NVNT	ax40	5670	Ant2	1000-5000	-40.14	-27	Pass
NVNT	ax40	5670	Ant2	5000-40000	-32.36	-27	Pass
NVNT	ax40	5710	Ant1	30-1000	-42.58	-27	Pass




China


NVNT	ax40	5710	Ant1	1000-5000	-40.05	-27	Pass
NVNT	ax40	5710	Ant1	5000-40000	-32.36	-27	Pass
NVNT	ax40	5710	Ant2	30-1000	-42.37	-27	Pass
NVNT	ax40	5710	Ant2	1000-5000	-40.02	-27	Pass
NVNT	ax40	5710	Ant2	5000-40000	-31.95	-27	Pass
NVNT	ax40	5755	Ant1	30-1000	-42.58	-27	Pass
NVNT	ax40	5755	Ant1	1000-5000	-40.16	-27	Pass
NVNT	ax40	5755	Ant1	5000-40000	-32.57	-27	Pass
NVNT	ax40	5795	Ant1	30-1000	-42.16	-27	Pass
NVNT	ax40	5795	Ant1	1000-5000	-40.05	-27	Pass
NVNT	ax40	5795	Ant1	5000-40000	-32.64	-27	Pass
NVNT	ax40	5755	Ant2	30-1000	-42.09	-27	Pass
NVNT	ax40	5755	Ant2	1000-5000	-38.95	-27	Pass
NVNT	ax40	5755	Ant2	5000-40000	-31.83	-27	Pass
NVNT	ax40	5795	Ant2	30-1000	-42.55	-27	Pass
NVNT	ax40	5795	Ant2	1000-5000	-39.93	-27	Pass
NVNT	ax40	5795	Ant2	5000-40000	-31.53	-27	Pass
NVNT	ax80	5210	Ant1	30-1000	-43.51	-27	Pass
NVNT	ax80	5210	Ant1	1000-5000	-41.96	-27	Pass
NVNT	ax80	5210	Ant1	5000-40000	-34.48	-27	Pass
NVNT	ax80	5210	Ant2	30-1000	-43.34	-27	Pass
NVNT	ax80	5210	Ant2	1000-5000	-41.91	-27	Pass
NVNT	ax80	5210	Ant2	5000-40000	-33.92	-27	Pass
NVNT	ax80	5290	Ant1	30-1000	-43.94	-27	Pass
NVNT	ax80	5290	Ant1	1000-5000	-41.89	-27	Pass
NVNT	ax80	5290	Ant1	5000-40000	-34.39	-27	Pass
NVNT	ax80	5290	Ant2	30-1000	-43.47	-27	Pass
NVNT	ax80	5290	Ant2	1000-5000	-37.52	-27	Pass
NVNT	ax80	5290	Ant2	5000-40000	-33.01	-27	Pass
NVNT	ax80	5530	Ant1	30-1000	-42.33	-27	Pass
NVNT	ax80	5530	Ant1	1000-5000	-40.17	-27	Pass
NVNT	ax80	5530	Ant1	5000-40000	-32.49	-27	Pass
NVNT	ax80	5610	Ant1	30-1000	-41.64	-27	Pass
NVNT	ax80	5610	Ant1	1000-5000	-39.82	-27	Pass
NVNT	ax80	5610	Ant1	5000-40000	-32.66	-27	Pass
NVNT	ax80	5530	Ant2	30-1000	-41.8	-27	Pass
NVNT	ax80	5530	Ant2	1000-5000	-39.74	-27	Pass
NVNT	ax80	5530	Ant2	5000-40000	-32.88	-27	Pass
NVNT	ax80	5610	Ant2	30-1000	-42.41	-27	Pass
NVNT	ax80	5610	Ant2	1000-5000	-39.81	-27	Pass
NVNT	ax80	5610	Ant2	5000-40000	-31.7	-27	Pass
NVNT	ax80	5690	Ant1	30-1000	-41.49	-27	Pass



China


NVNT	ax80	5690	Ant1	1000-5000	-39.02	-27	Pass
NVNT	ax80	5690	Ant1	5000-40000	-31.87	-27	Pass
NVNT	ax80	5690	Ant2	30-1000	-41.56	-27	Pass
NVNT	ax80	5690	Ant2	1000-5000	-39.29	-27	Pass
NVNT	ax80	5690	Ant2	5000-40000	-32.52	-27	Pass
NVNT	ax80	5775	Ant1	30-1000	-42.3	-27	Pass
NVNT	ax80	5775	Ant1	1000-5000	-39.85	-27	Pass
NVNT	ax80	5775	Ant1	5000-40000	-32.94	-27	Pass
NVNT	ax80	5775	Ant2	30-1000	-42.24	-27	Pass
NVNT	ax80	5775	Ant2	1000-5000	-39.74	-27	Pass
NVNT	ax80	5775	Ant2	5000-40000	-32.46	-27	Pass

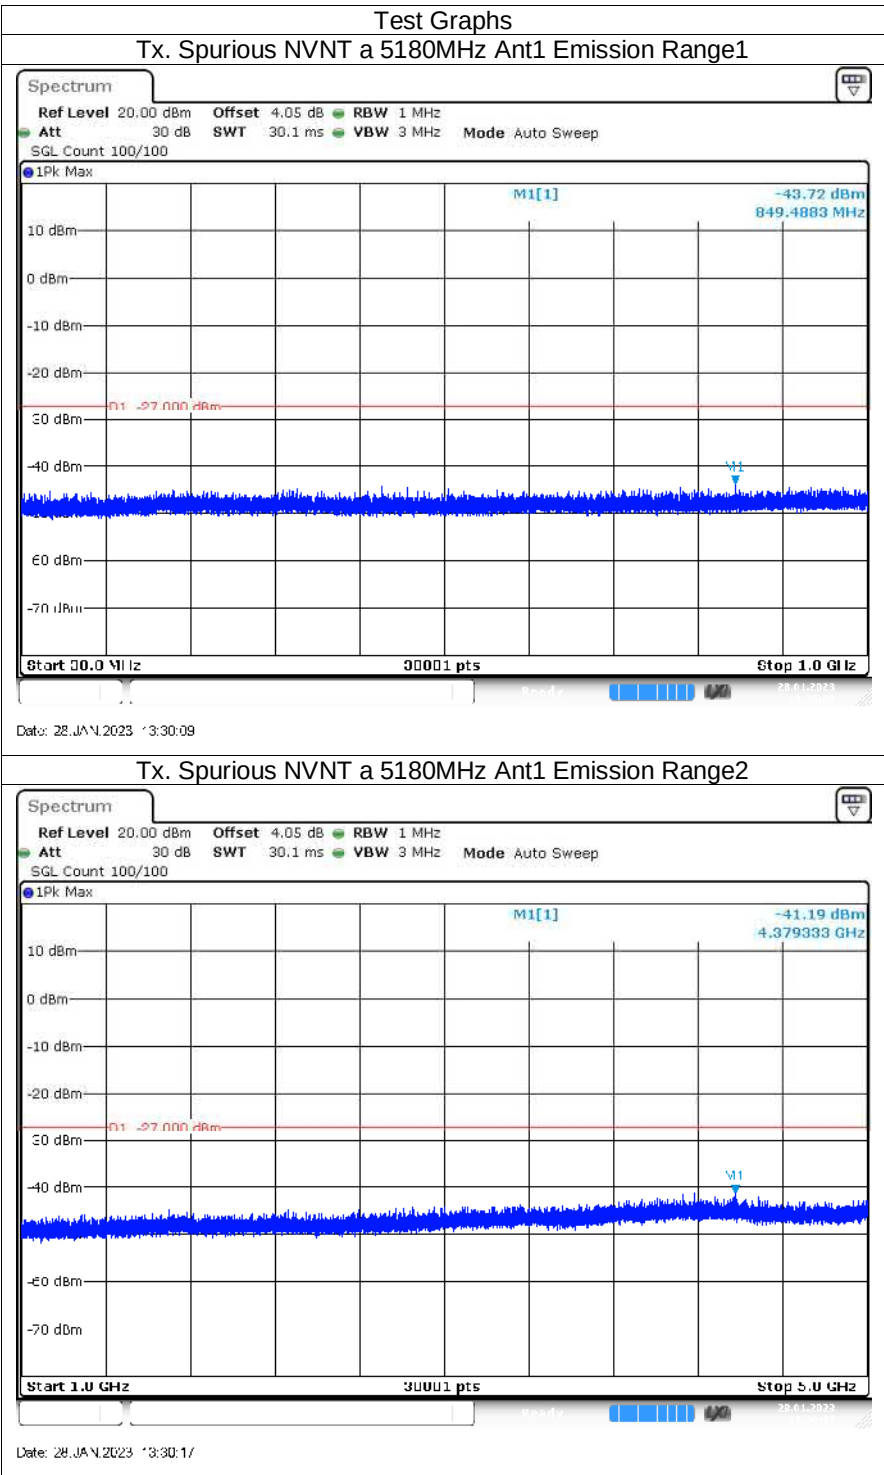

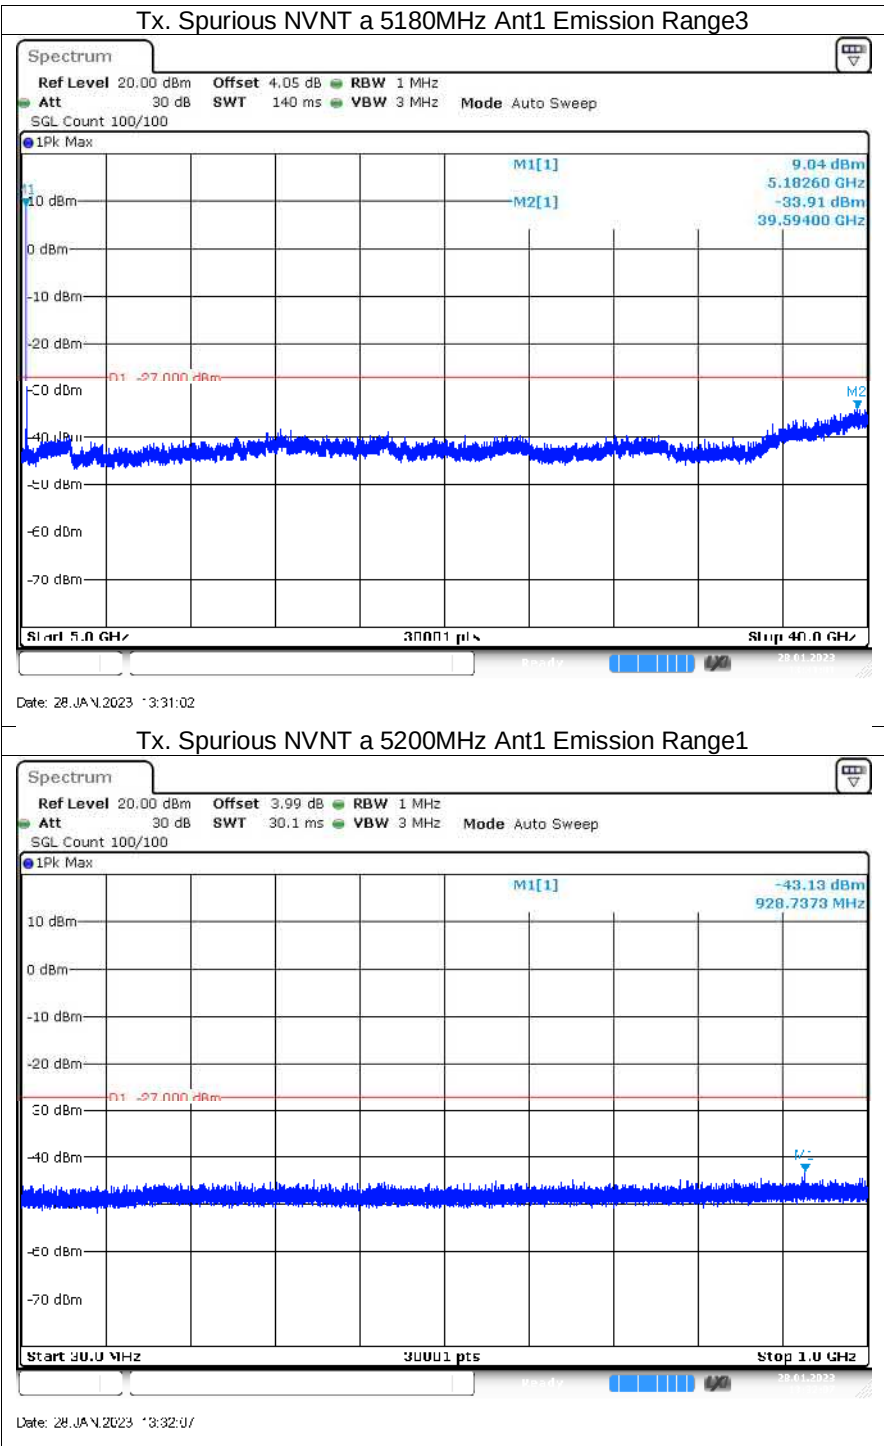





China

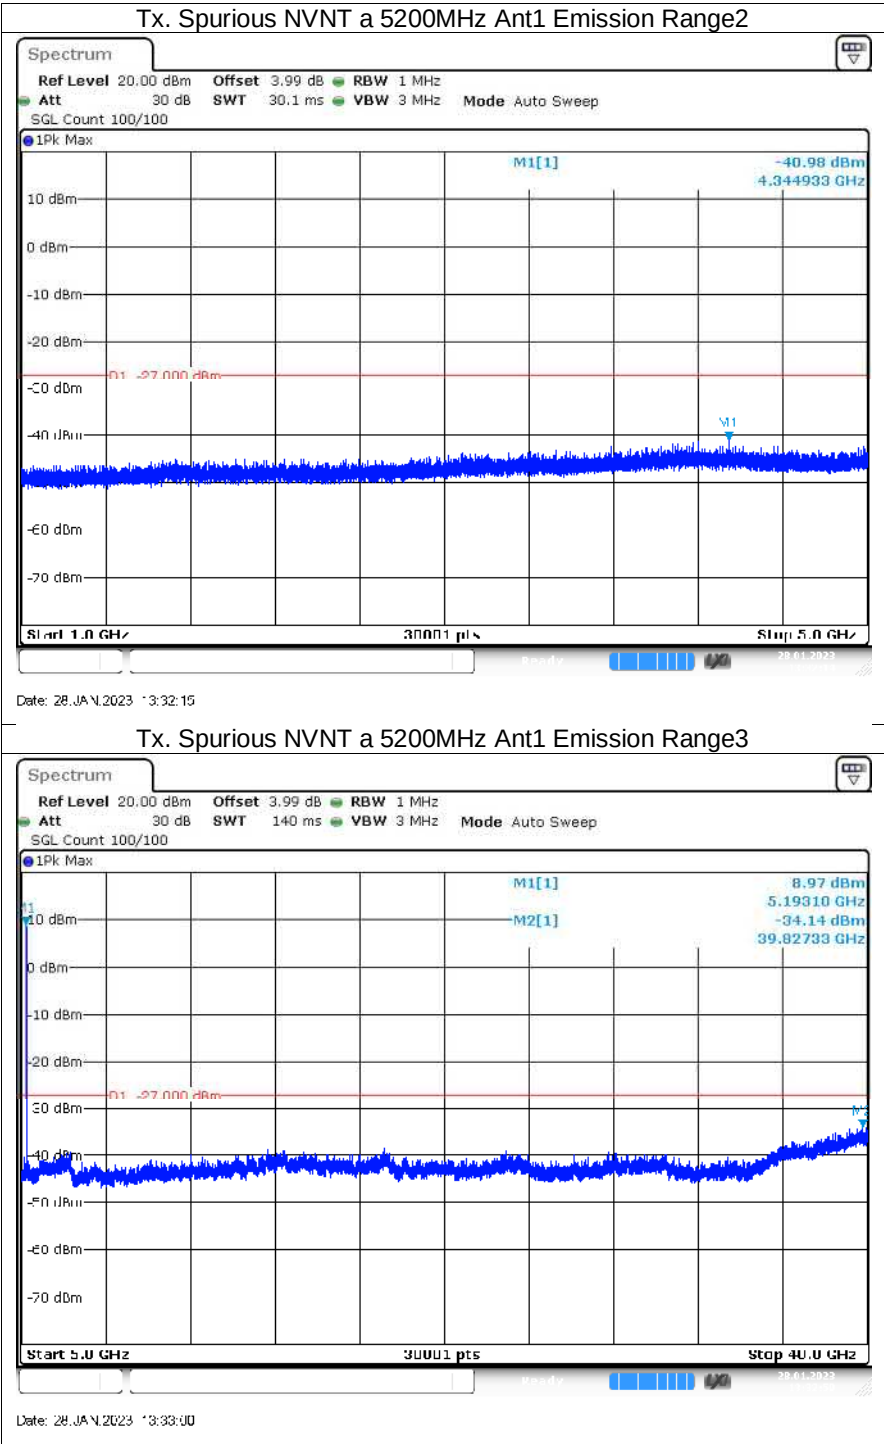





China

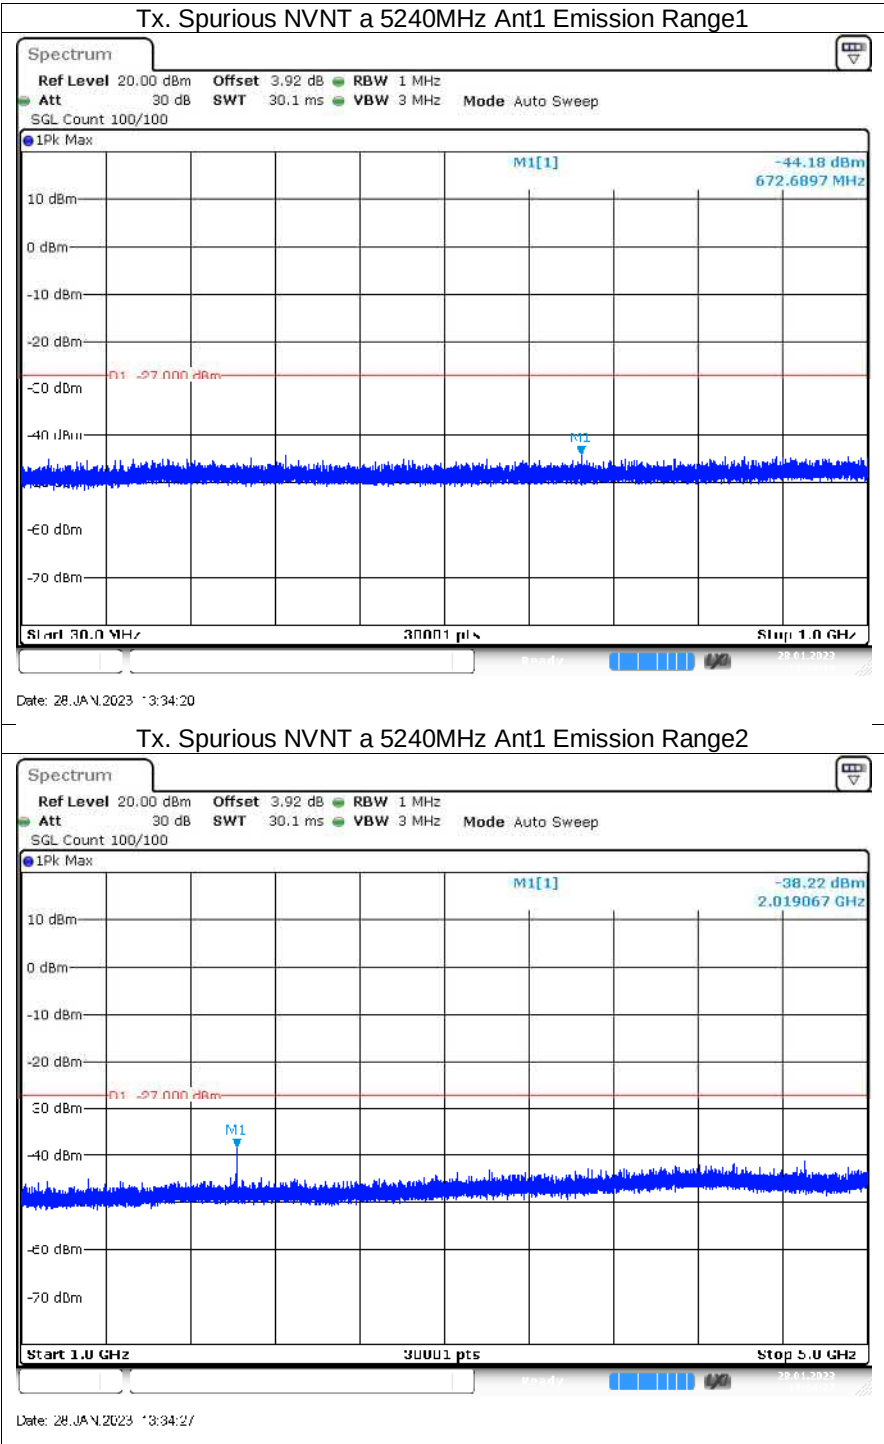

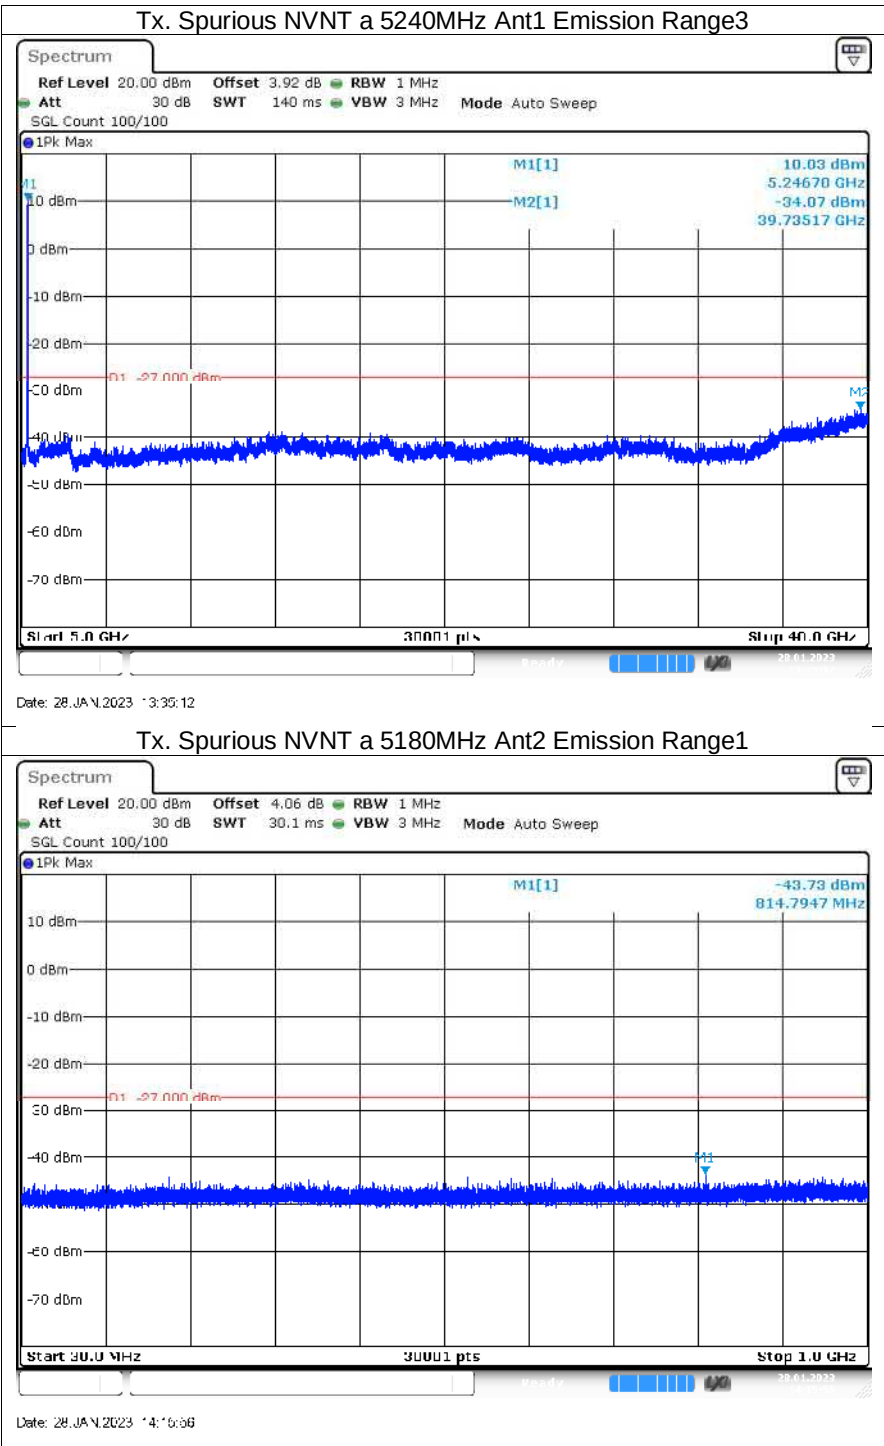


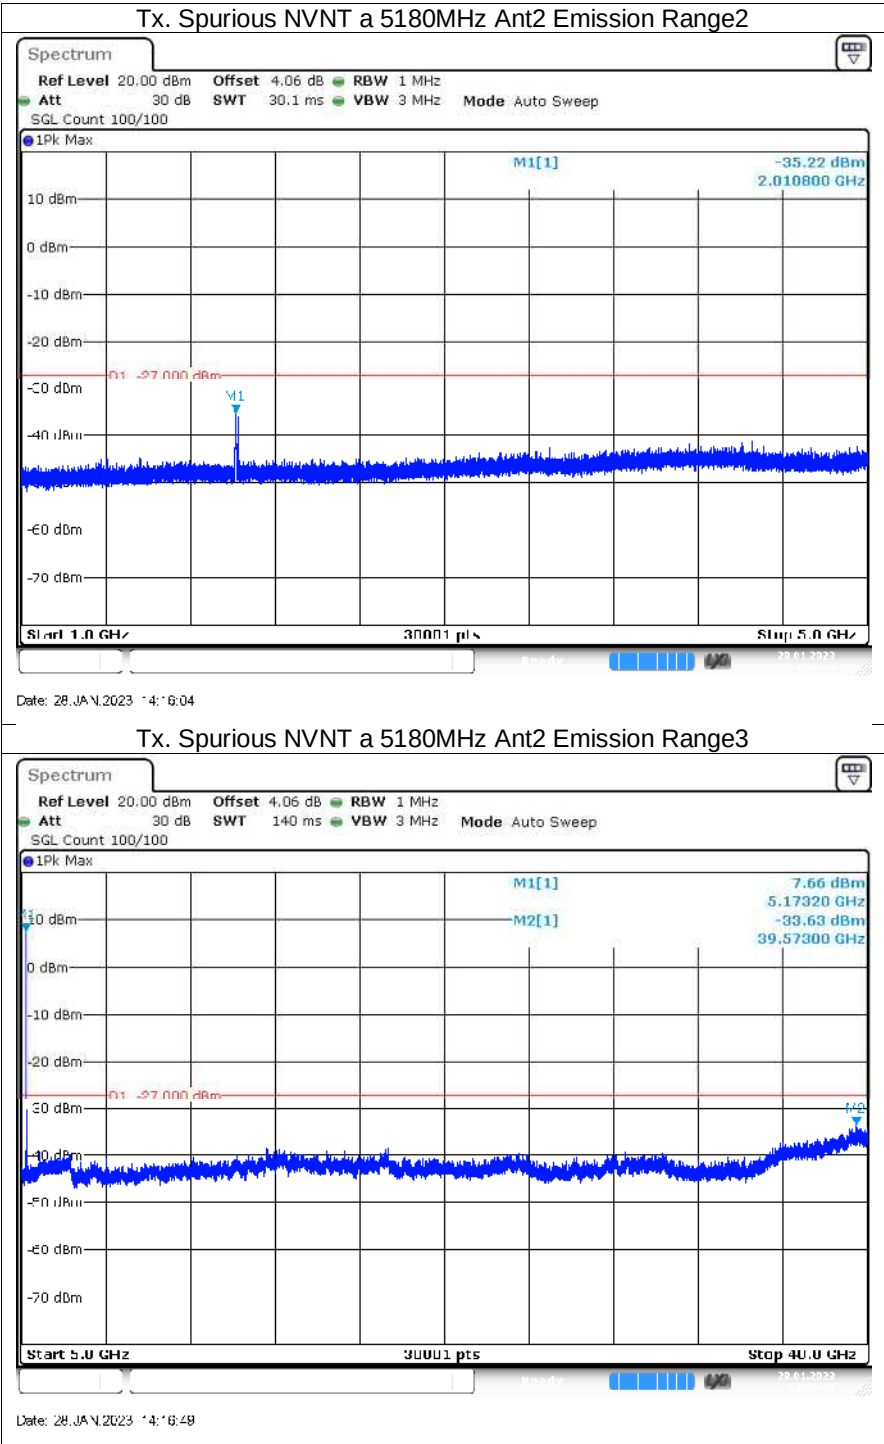


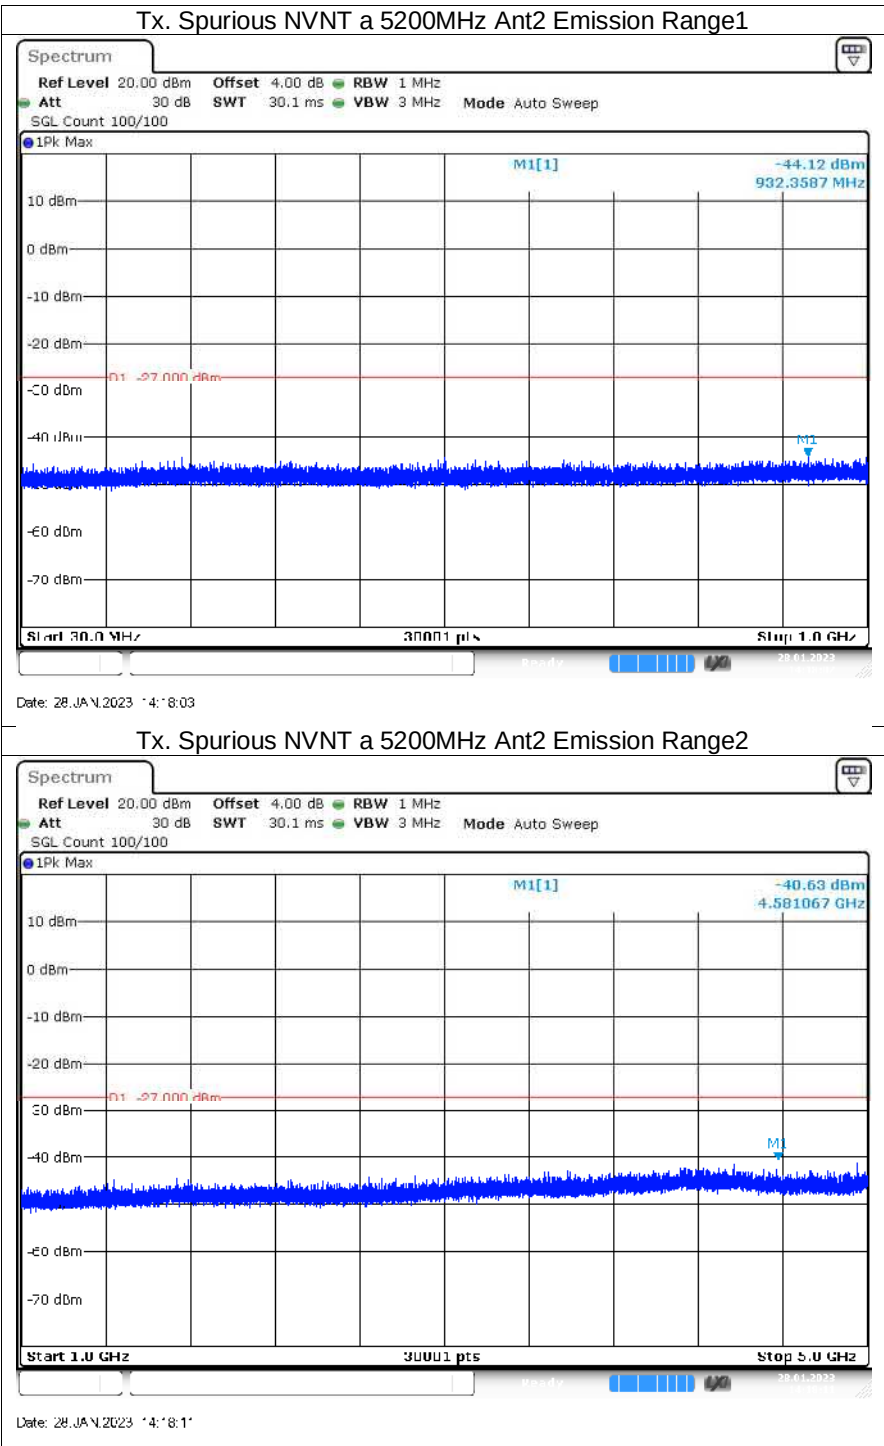







China

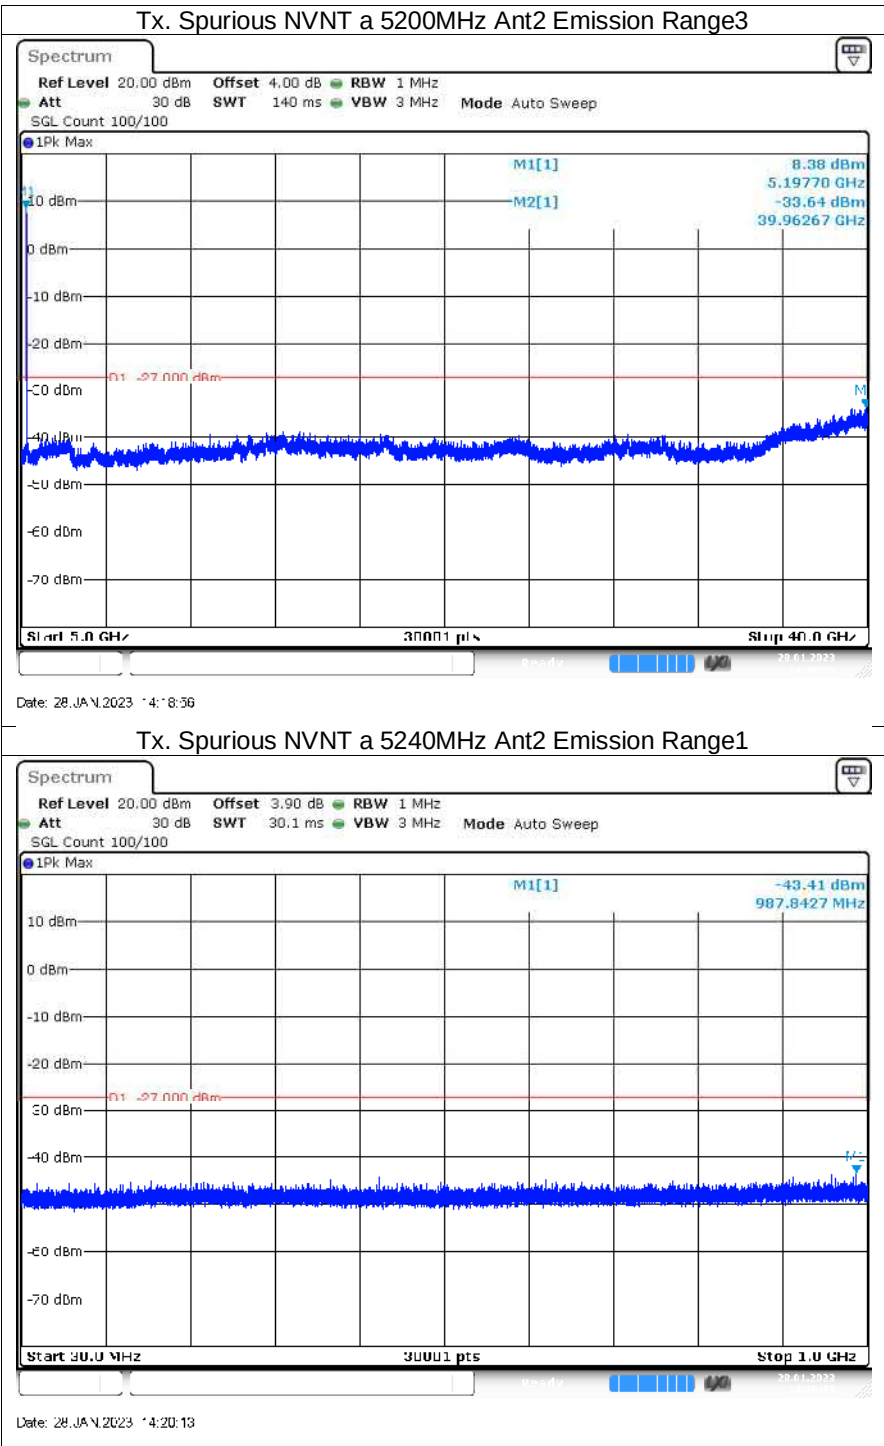


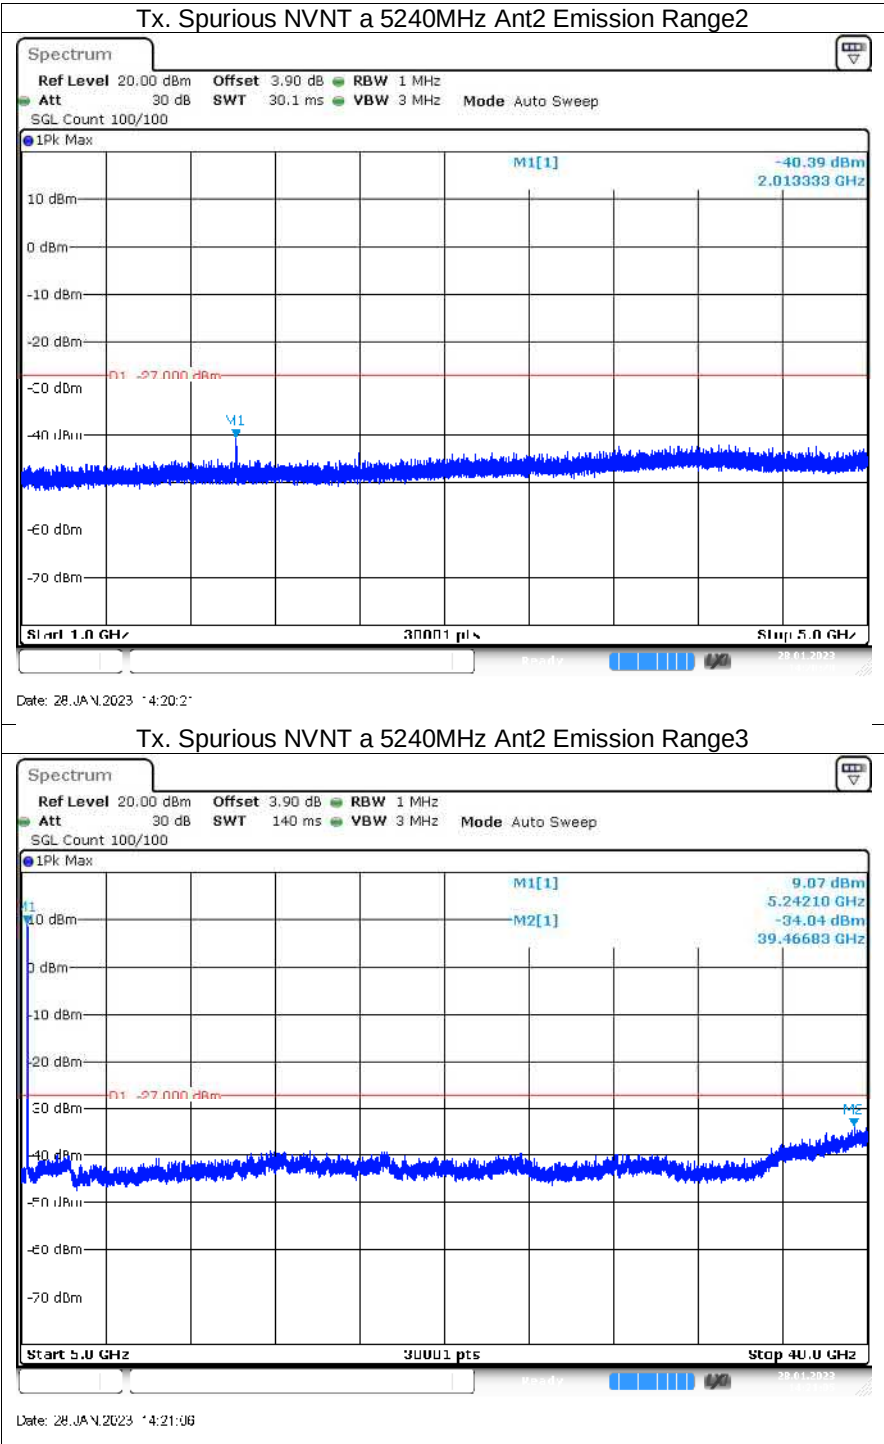


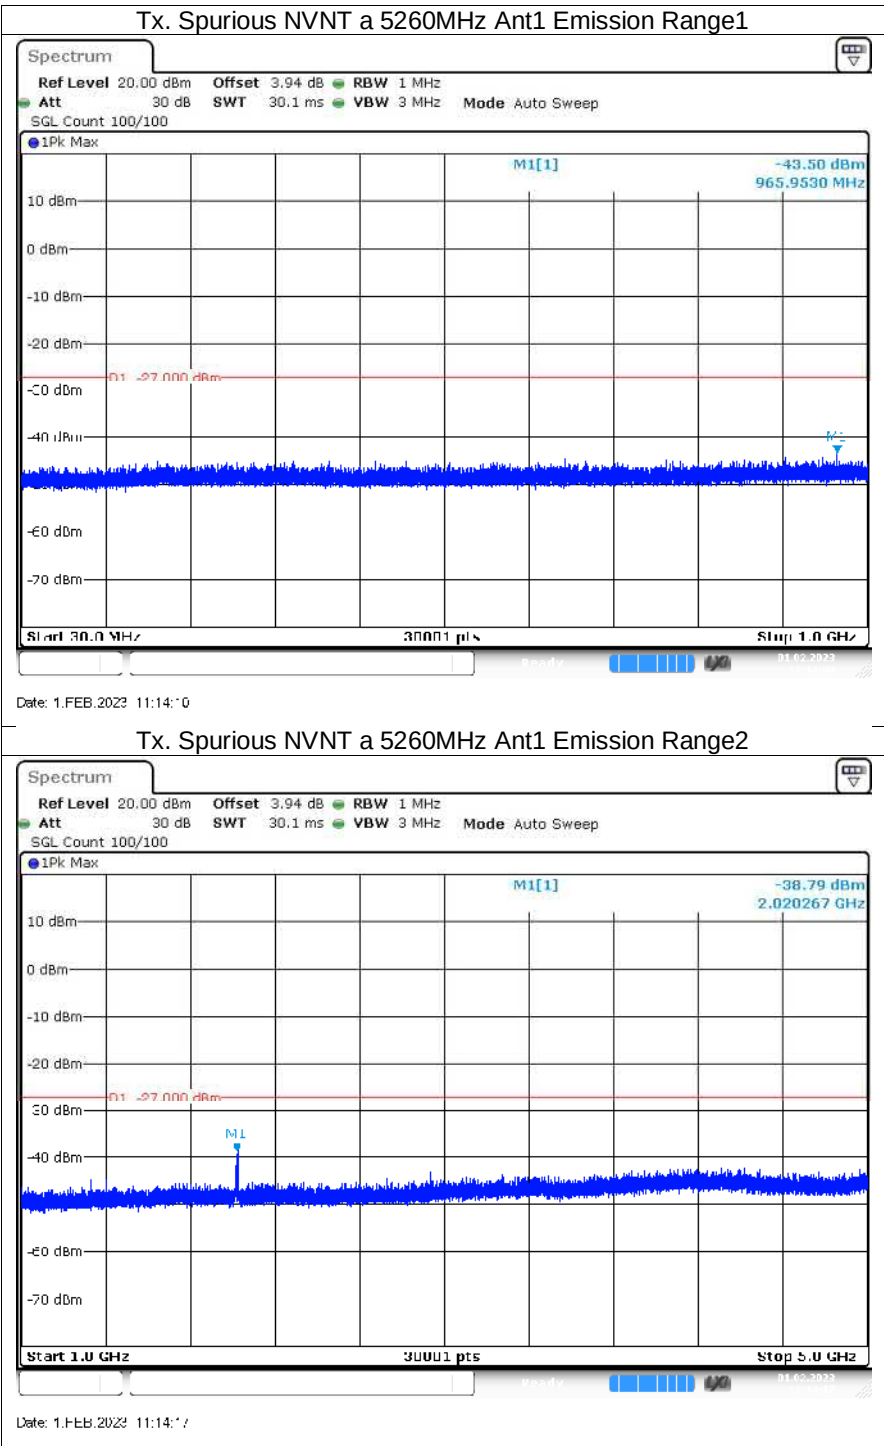


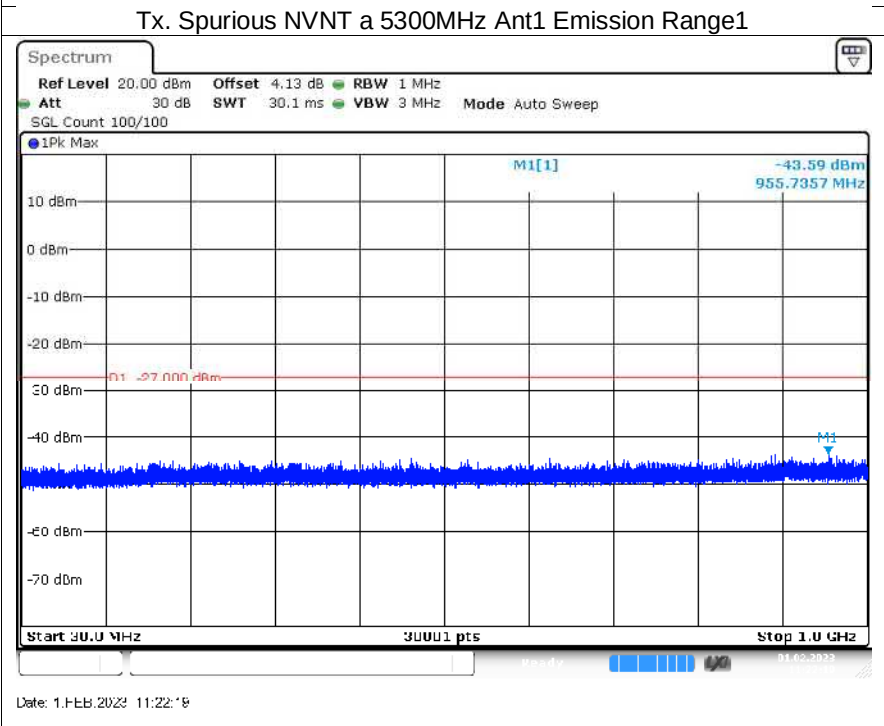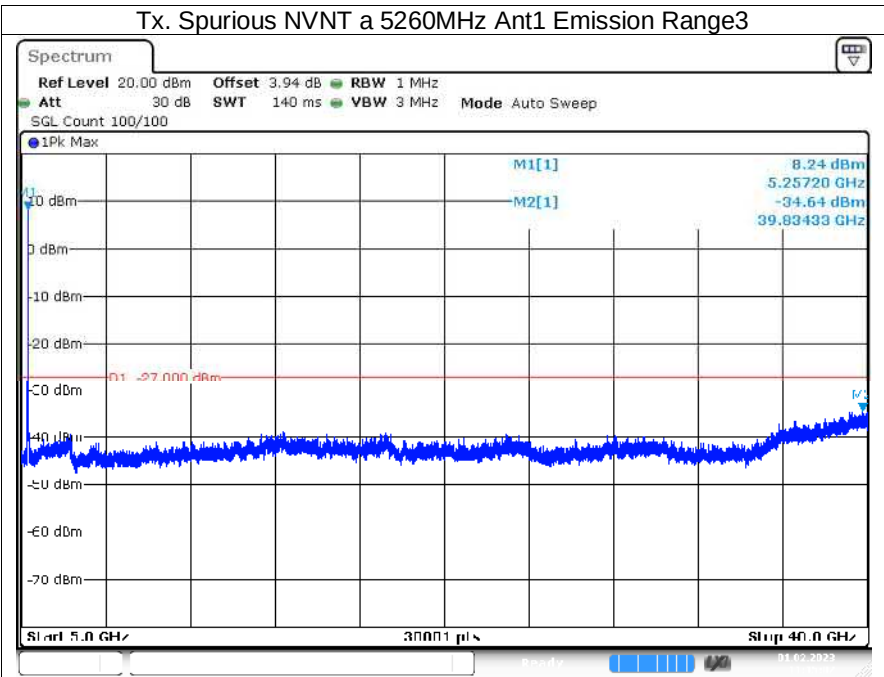


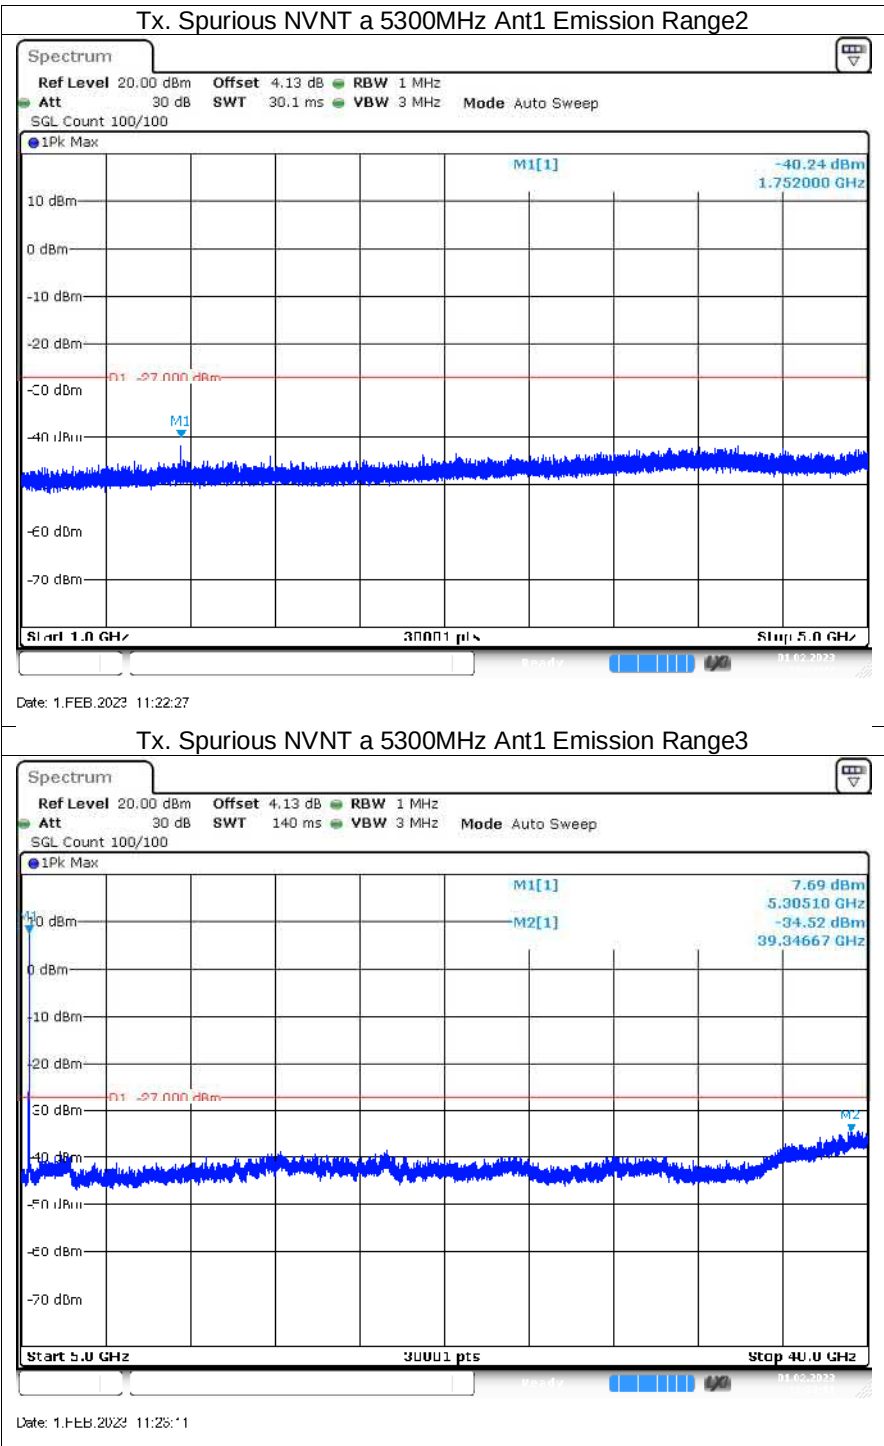


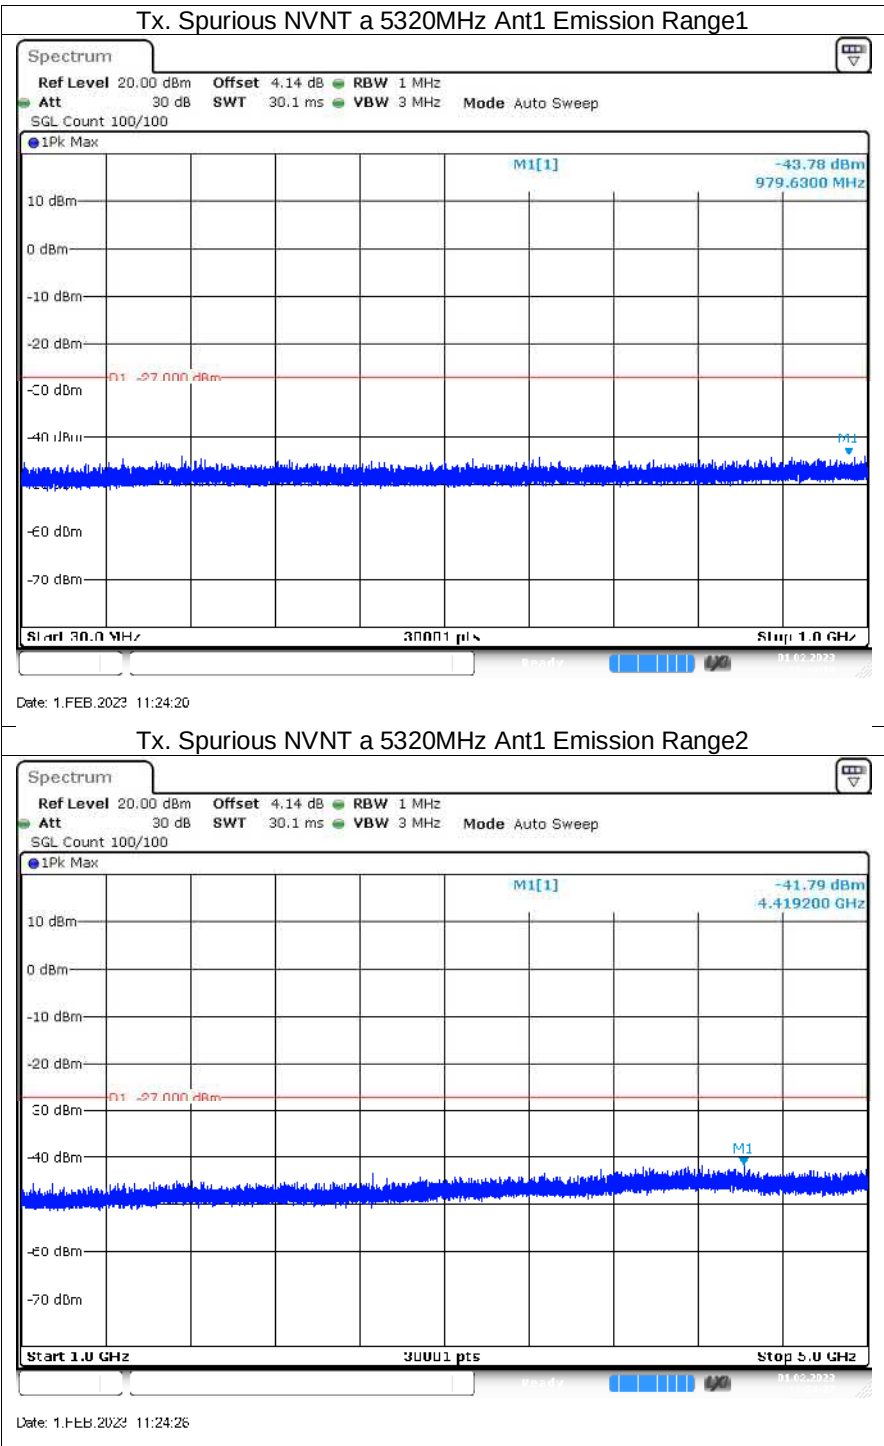


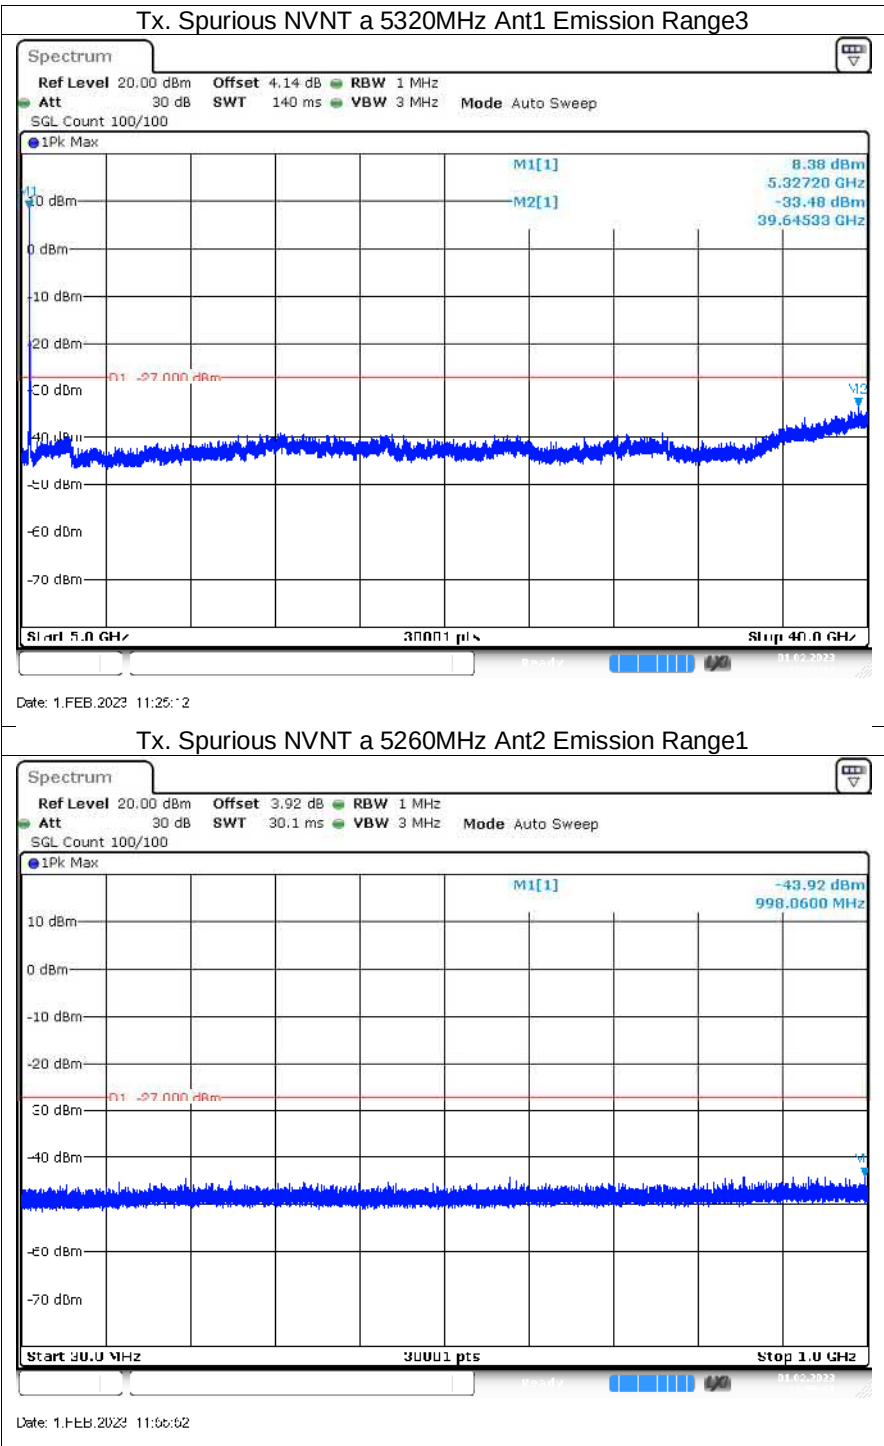


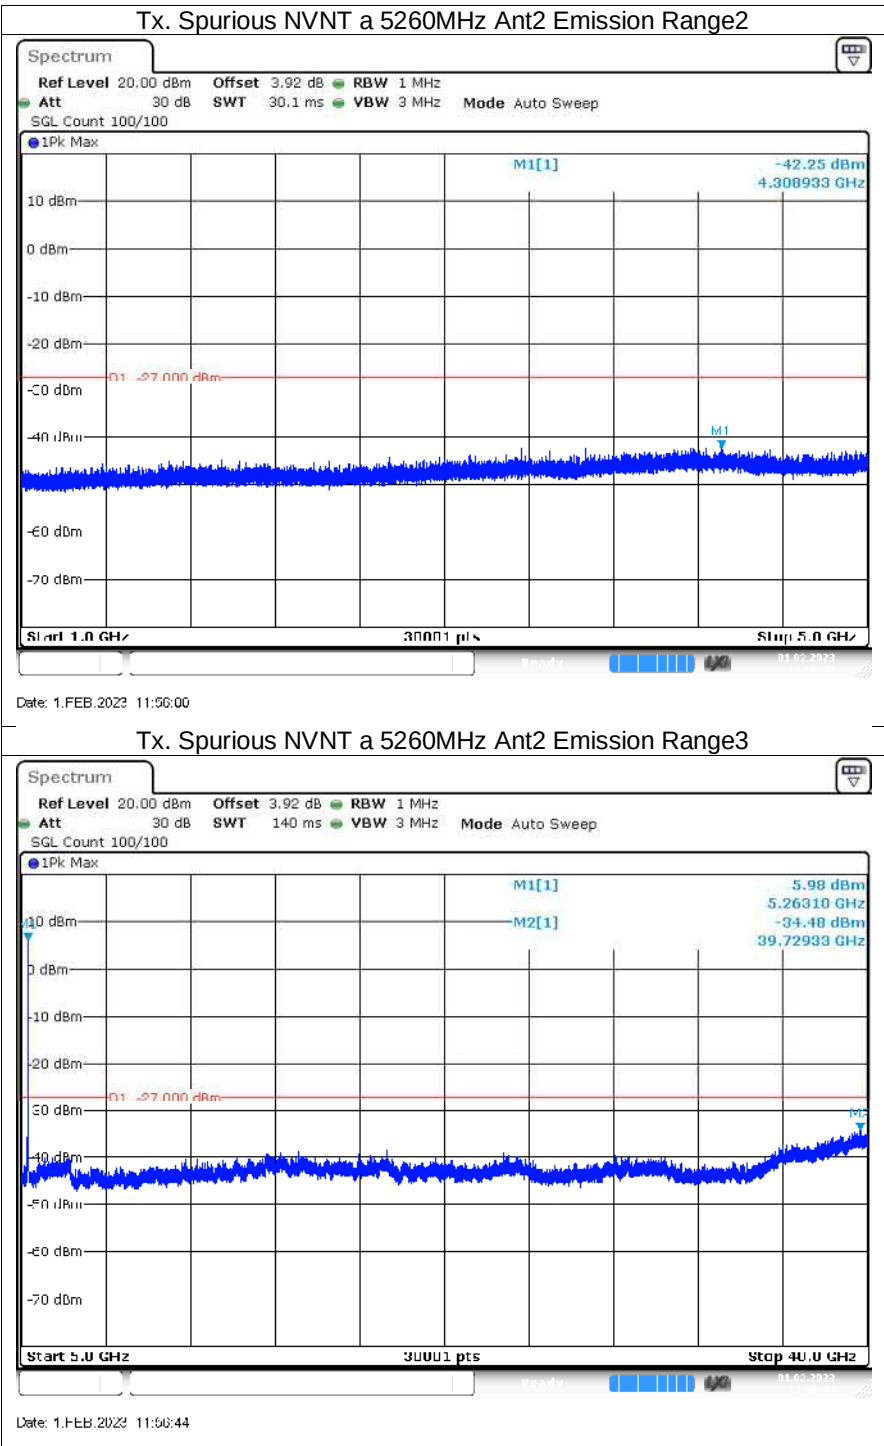


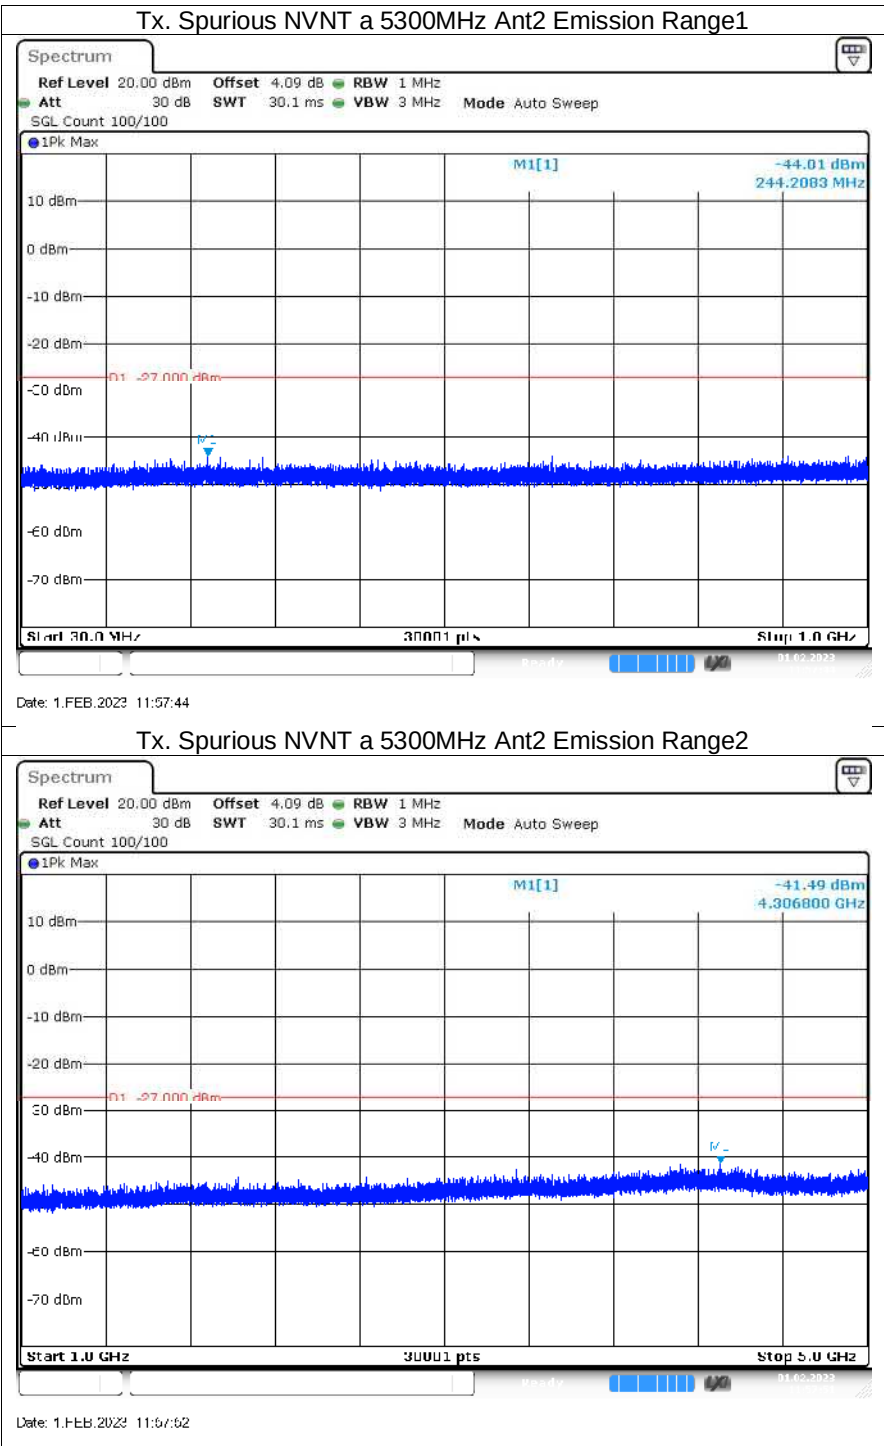


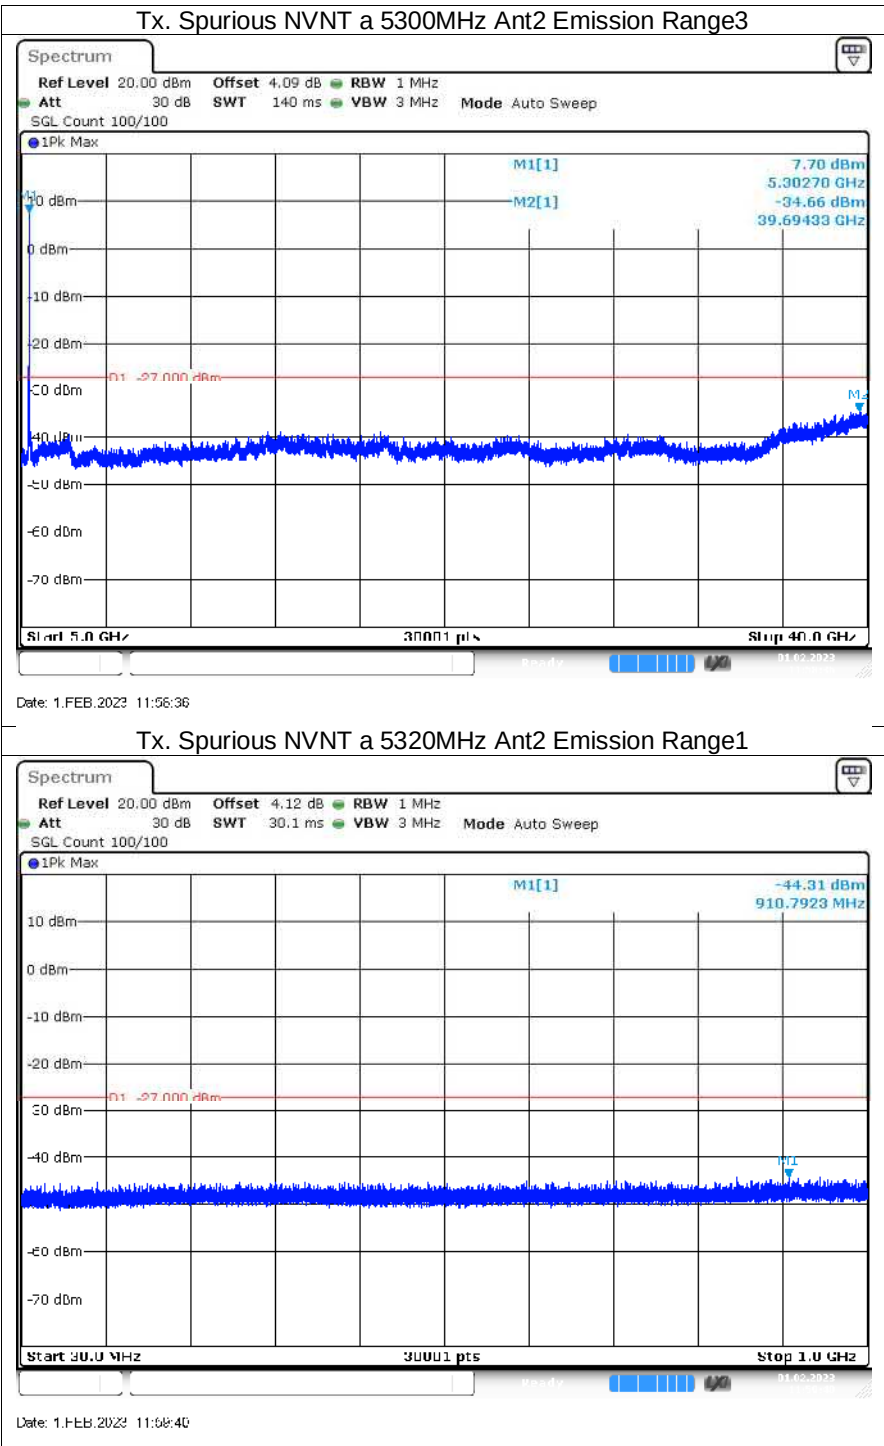


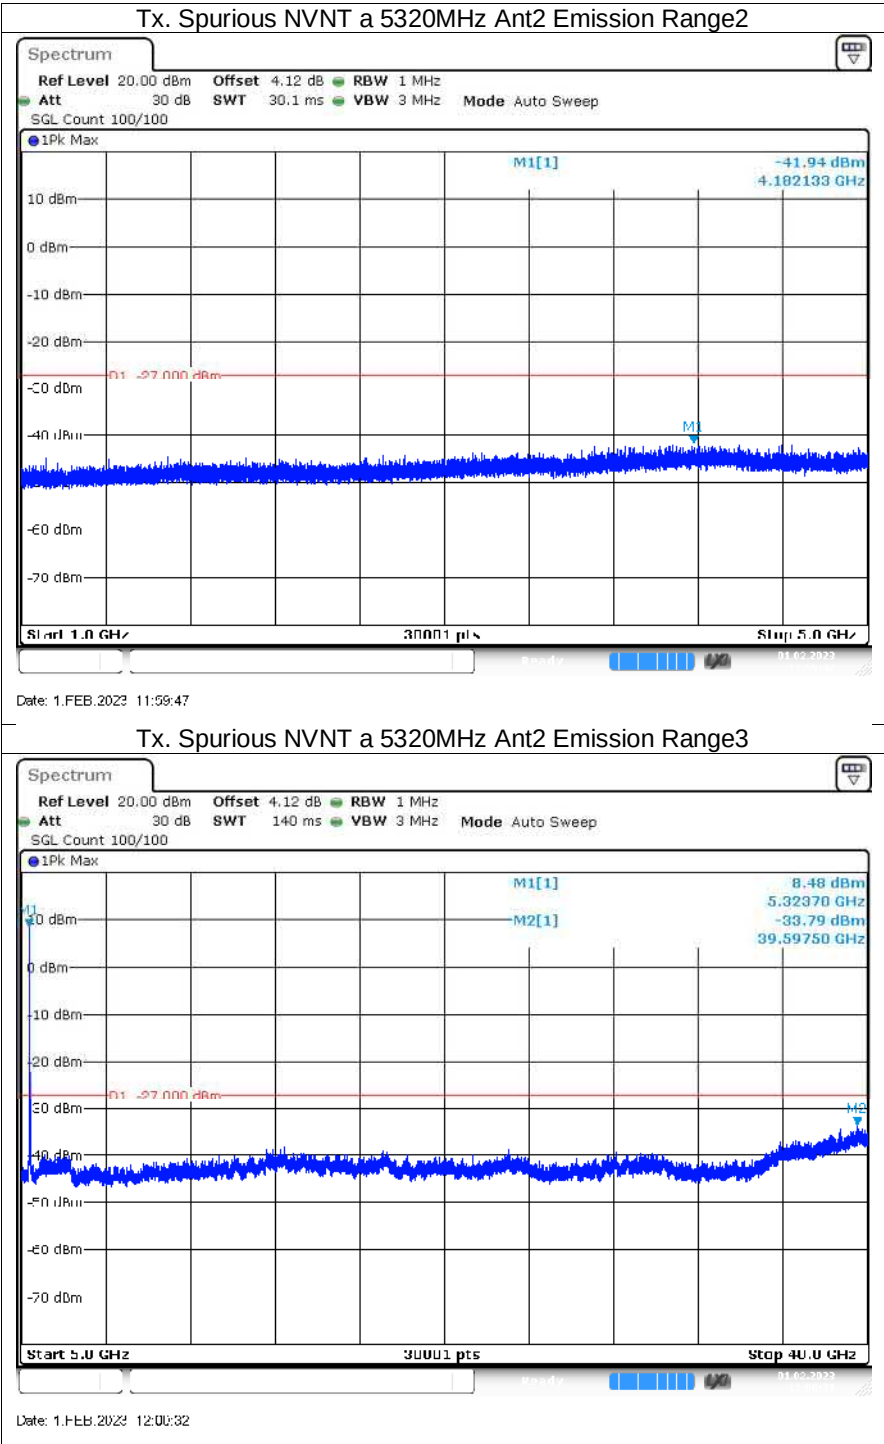


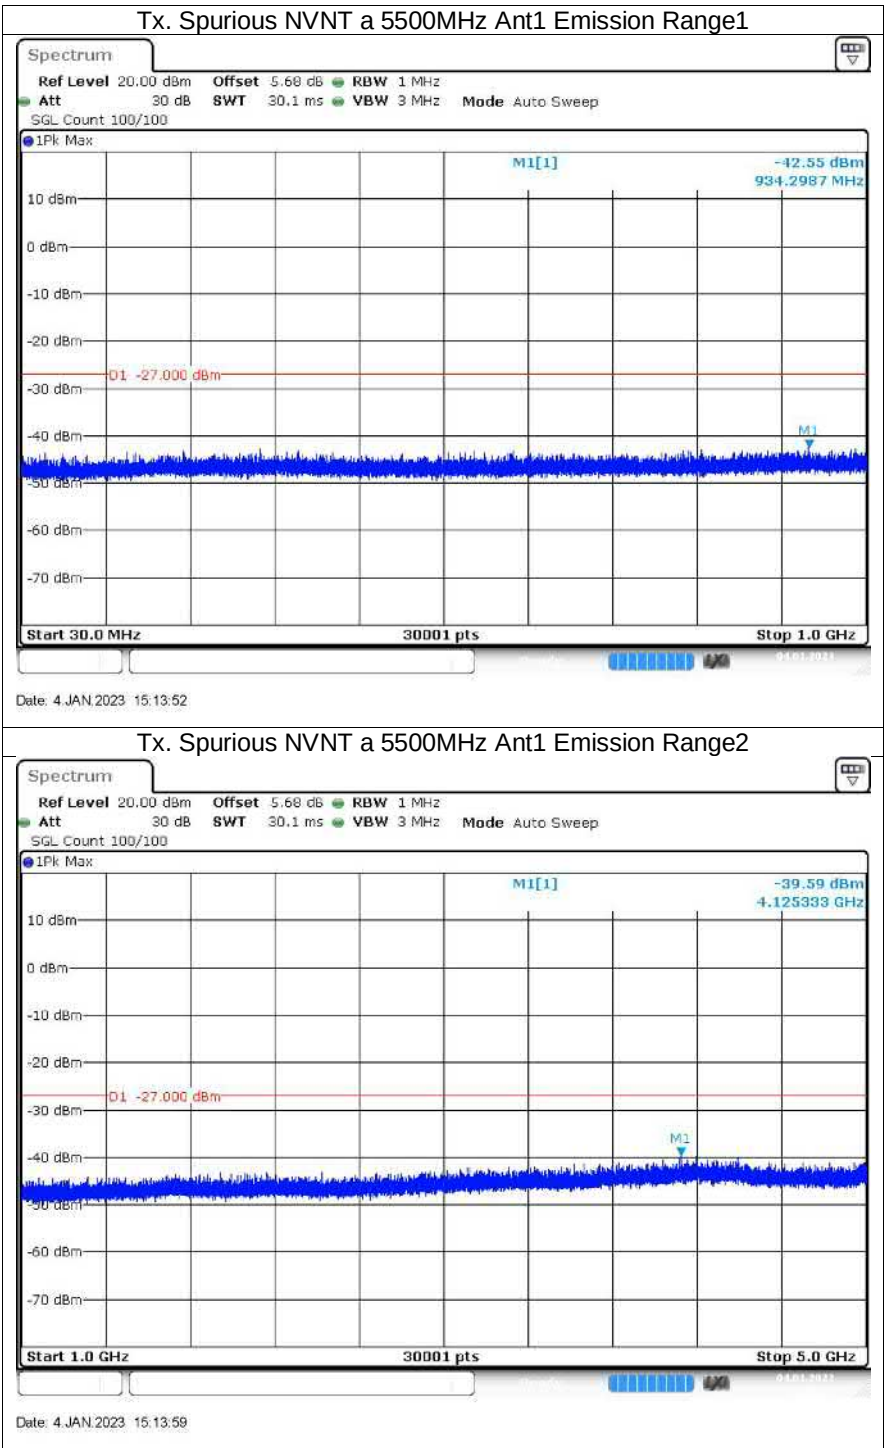


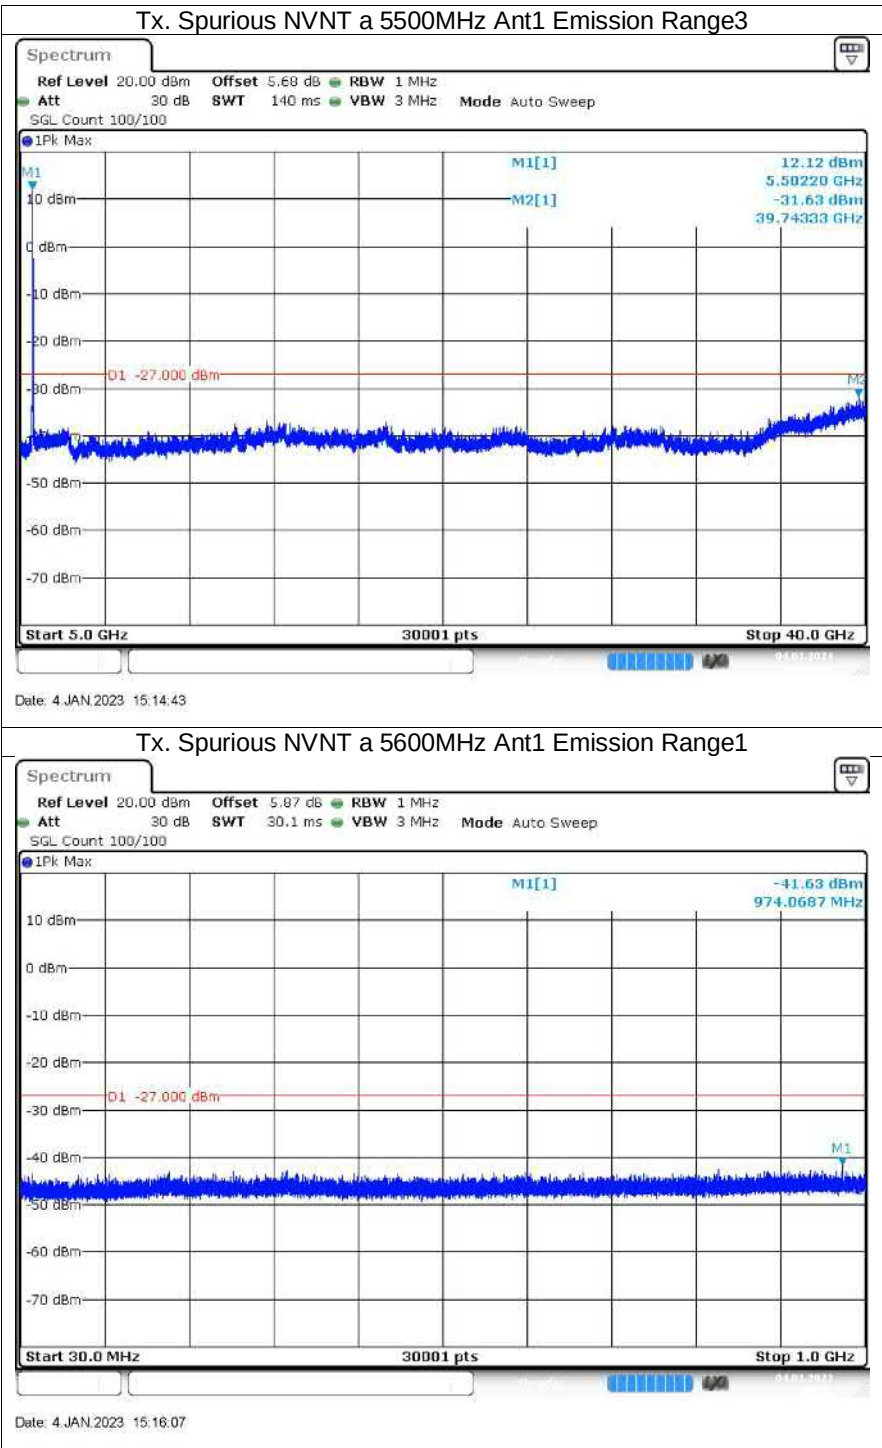


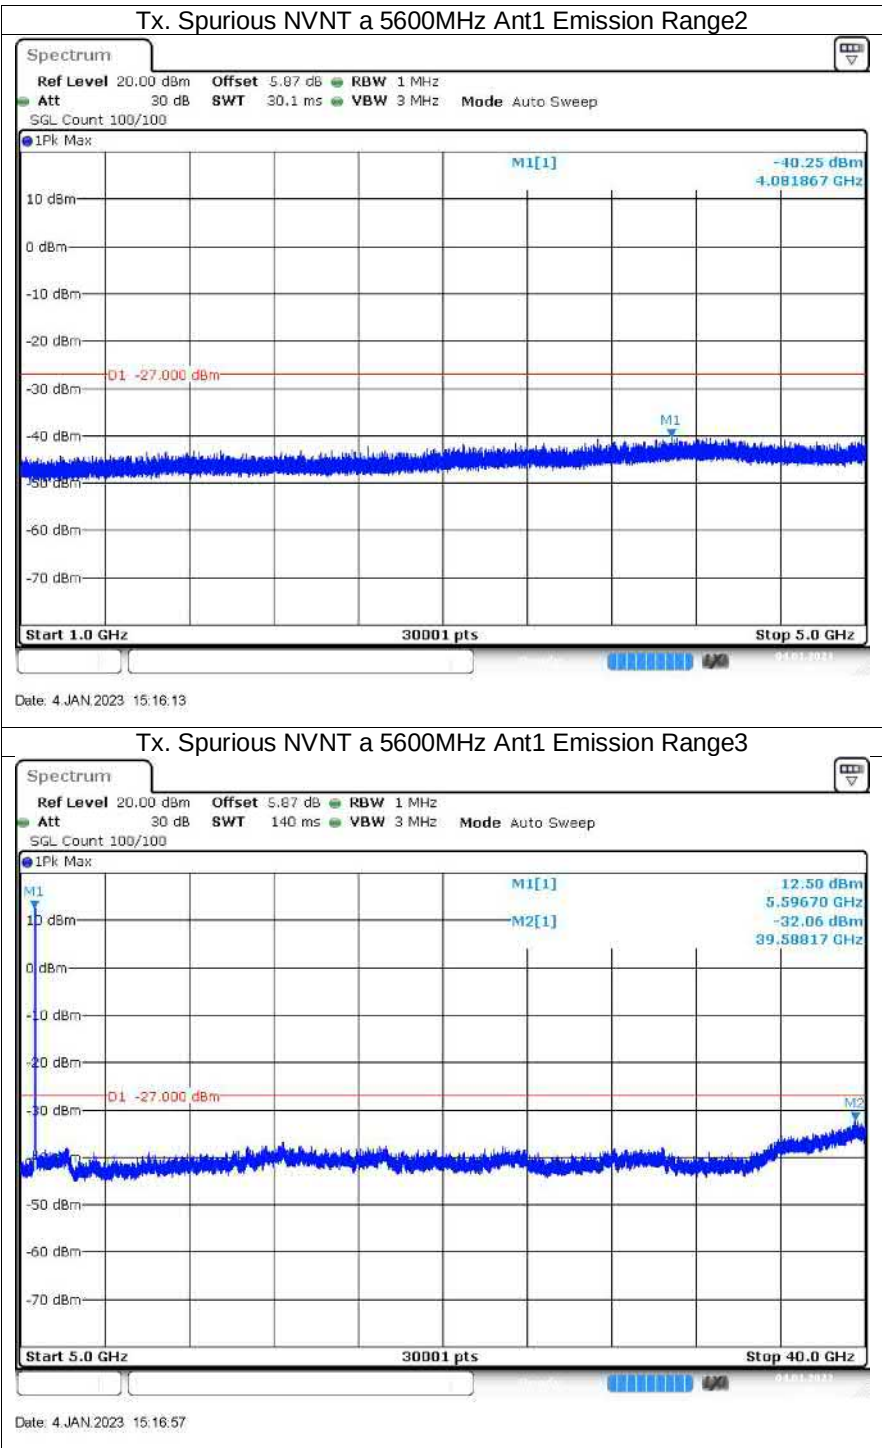


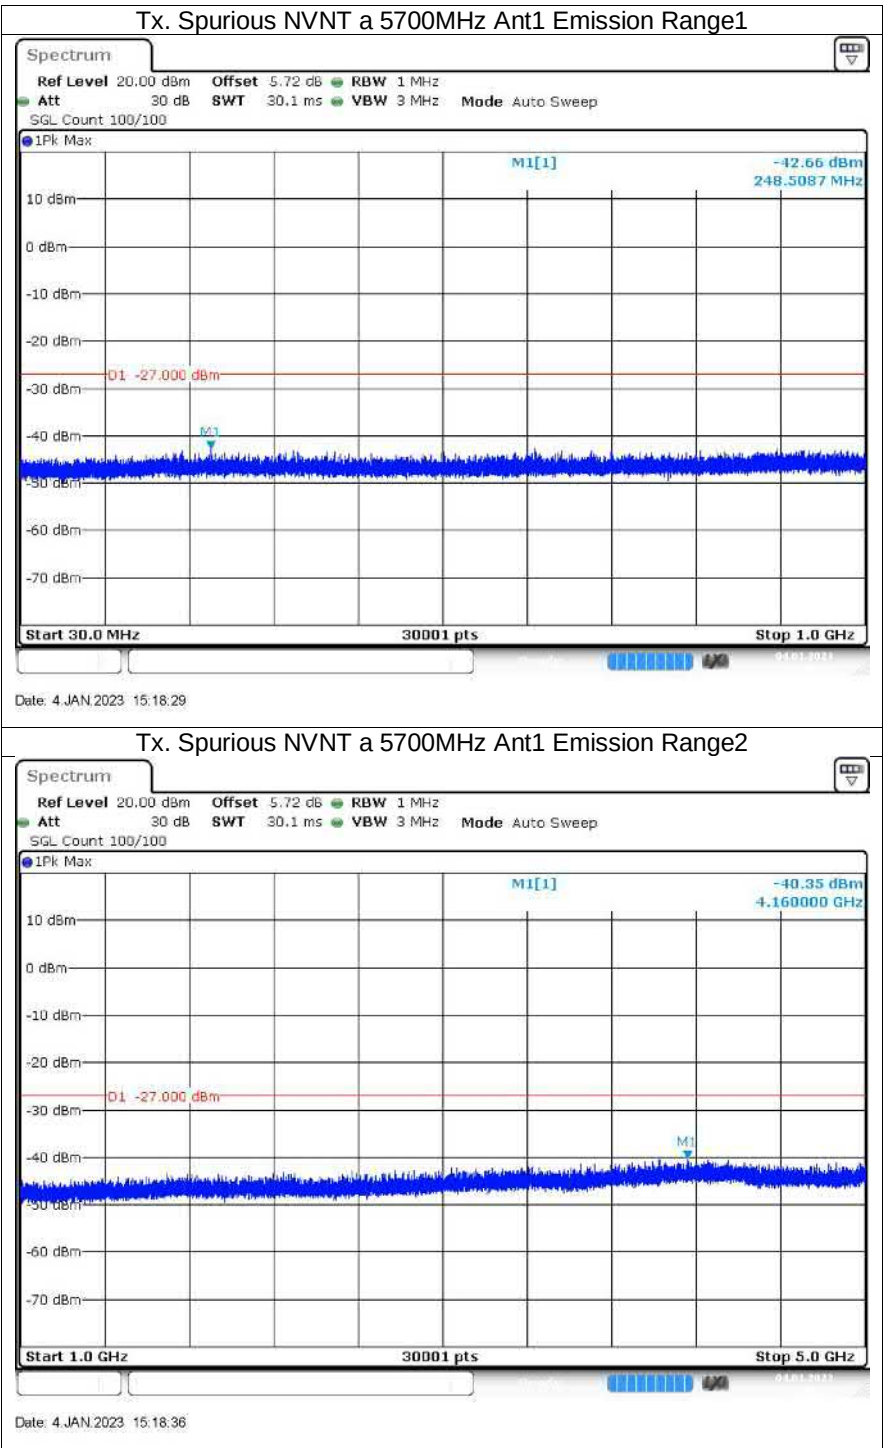


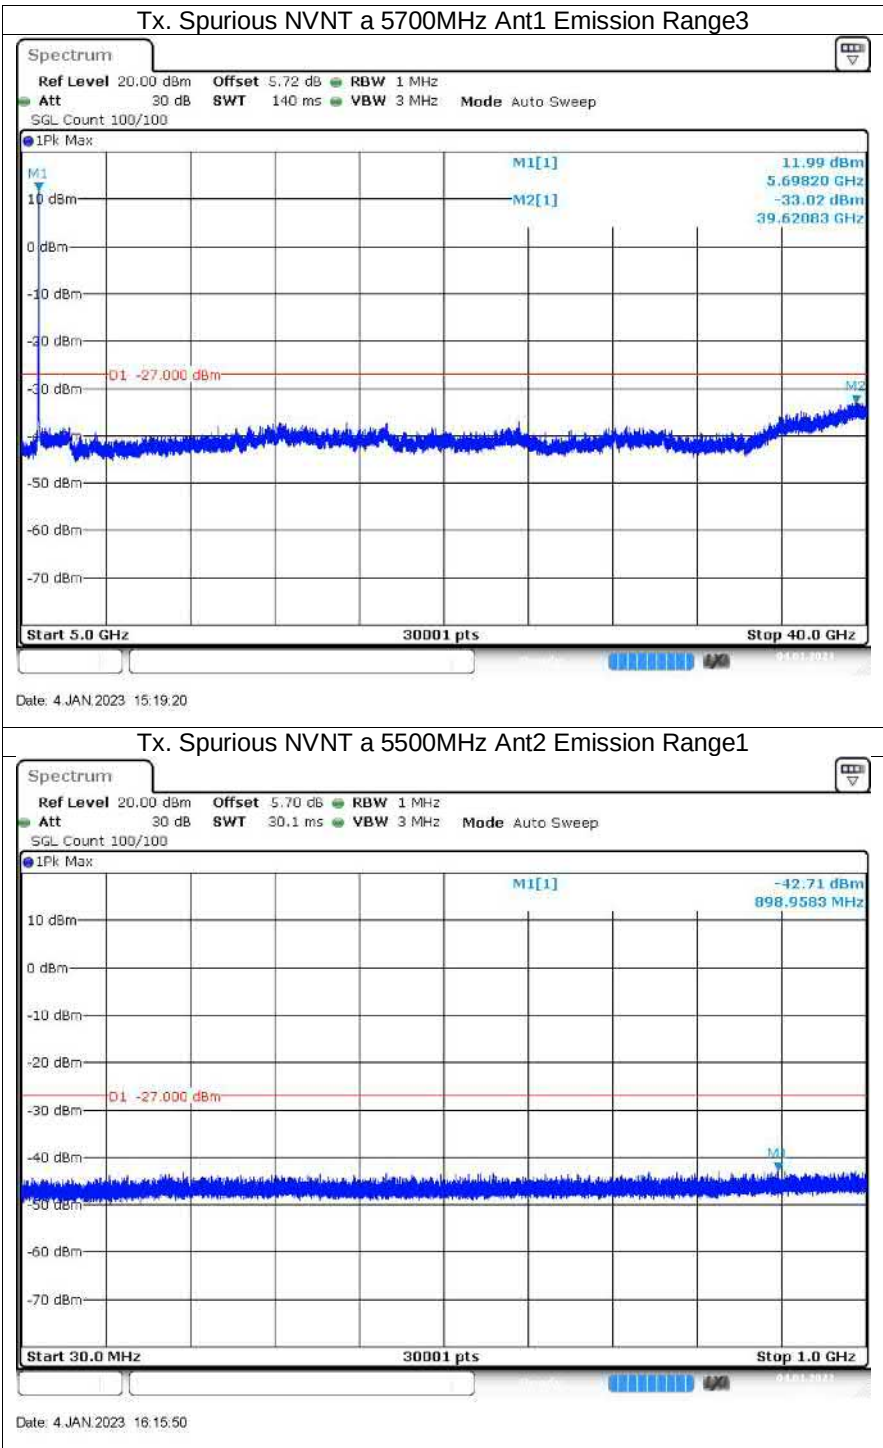


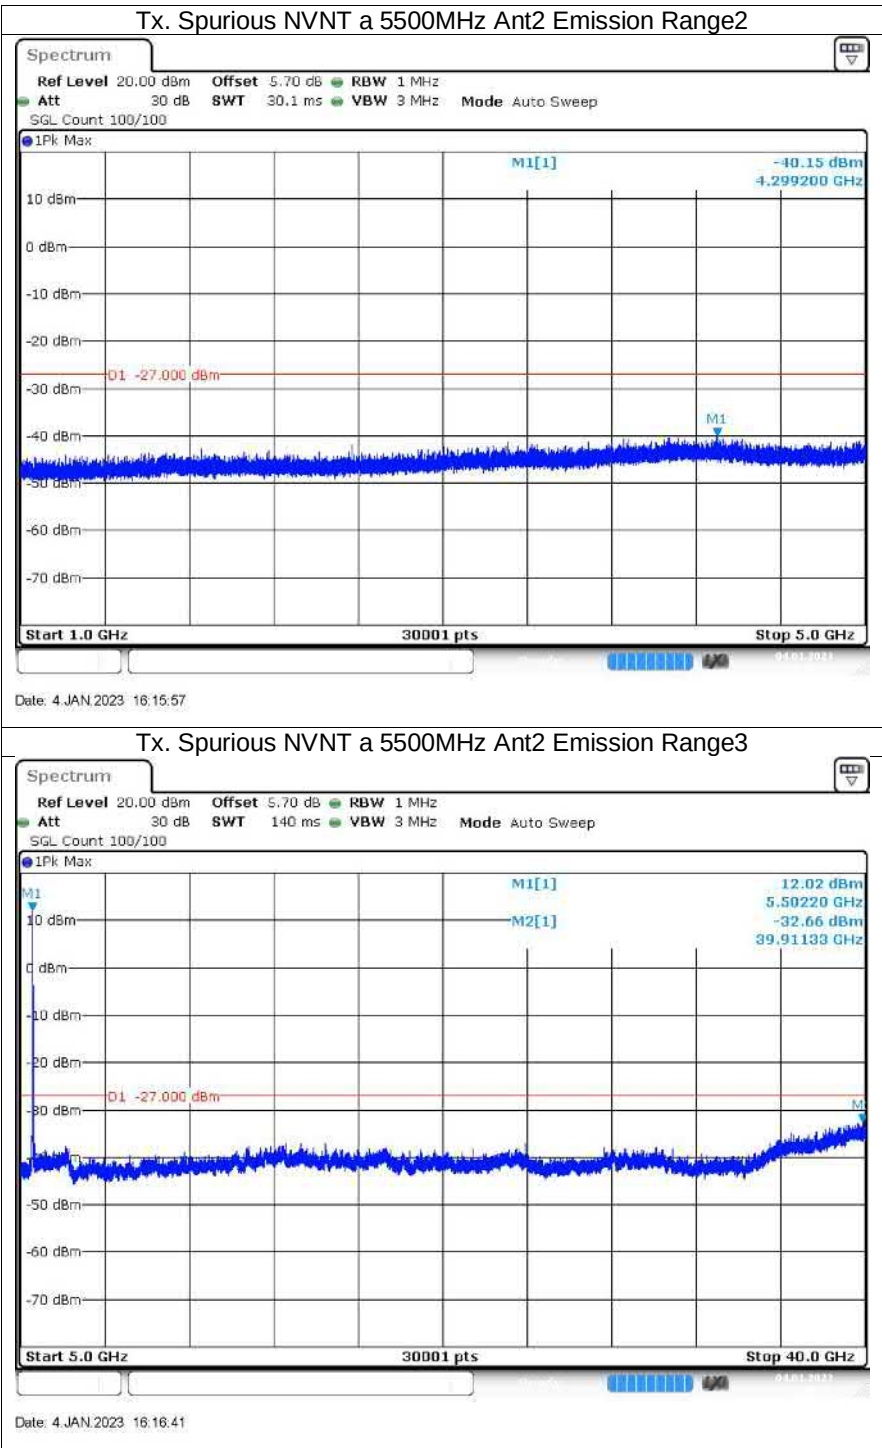


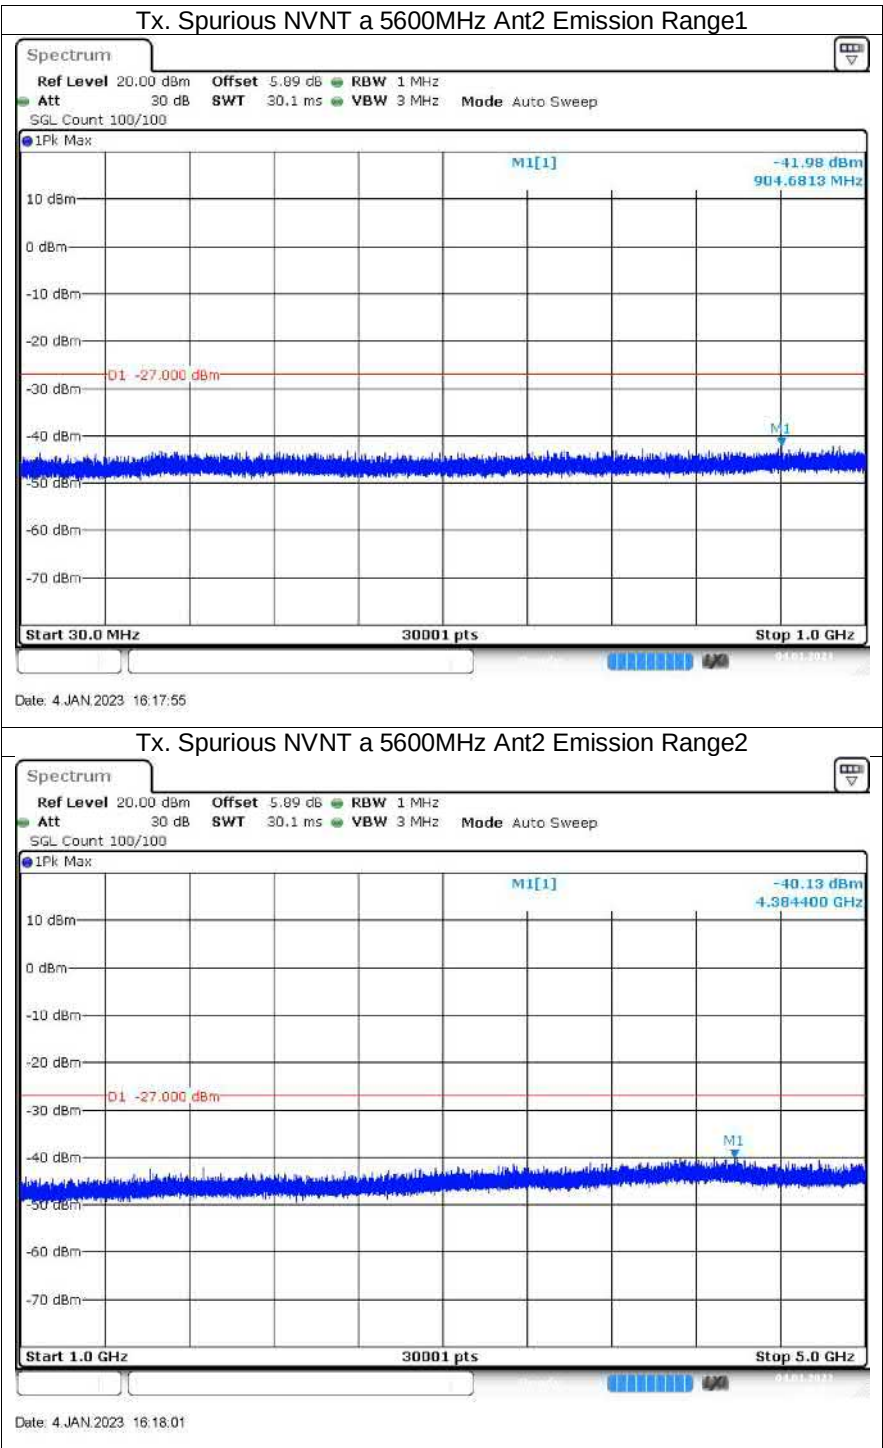


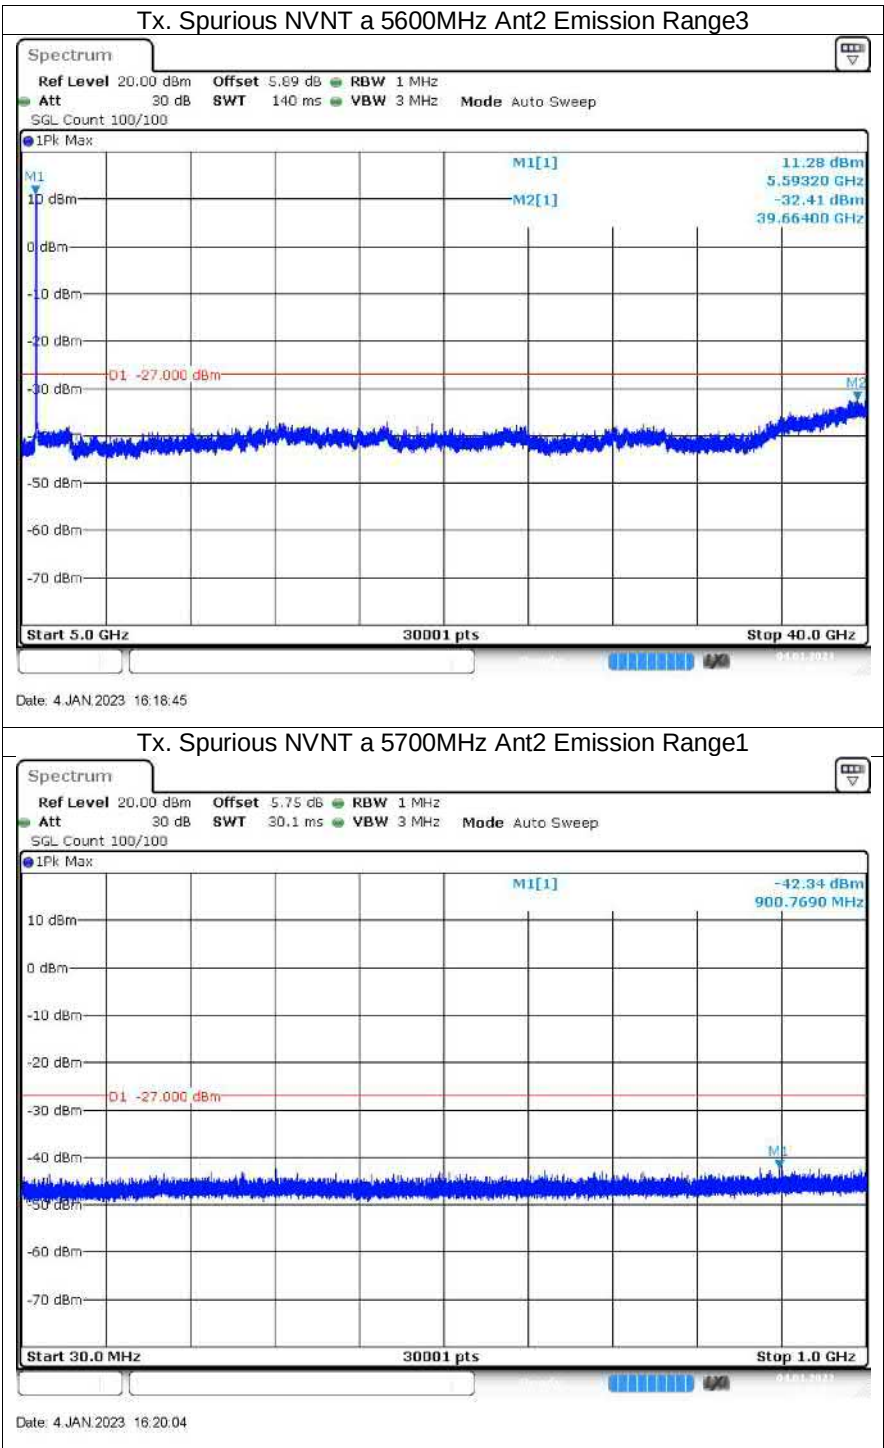


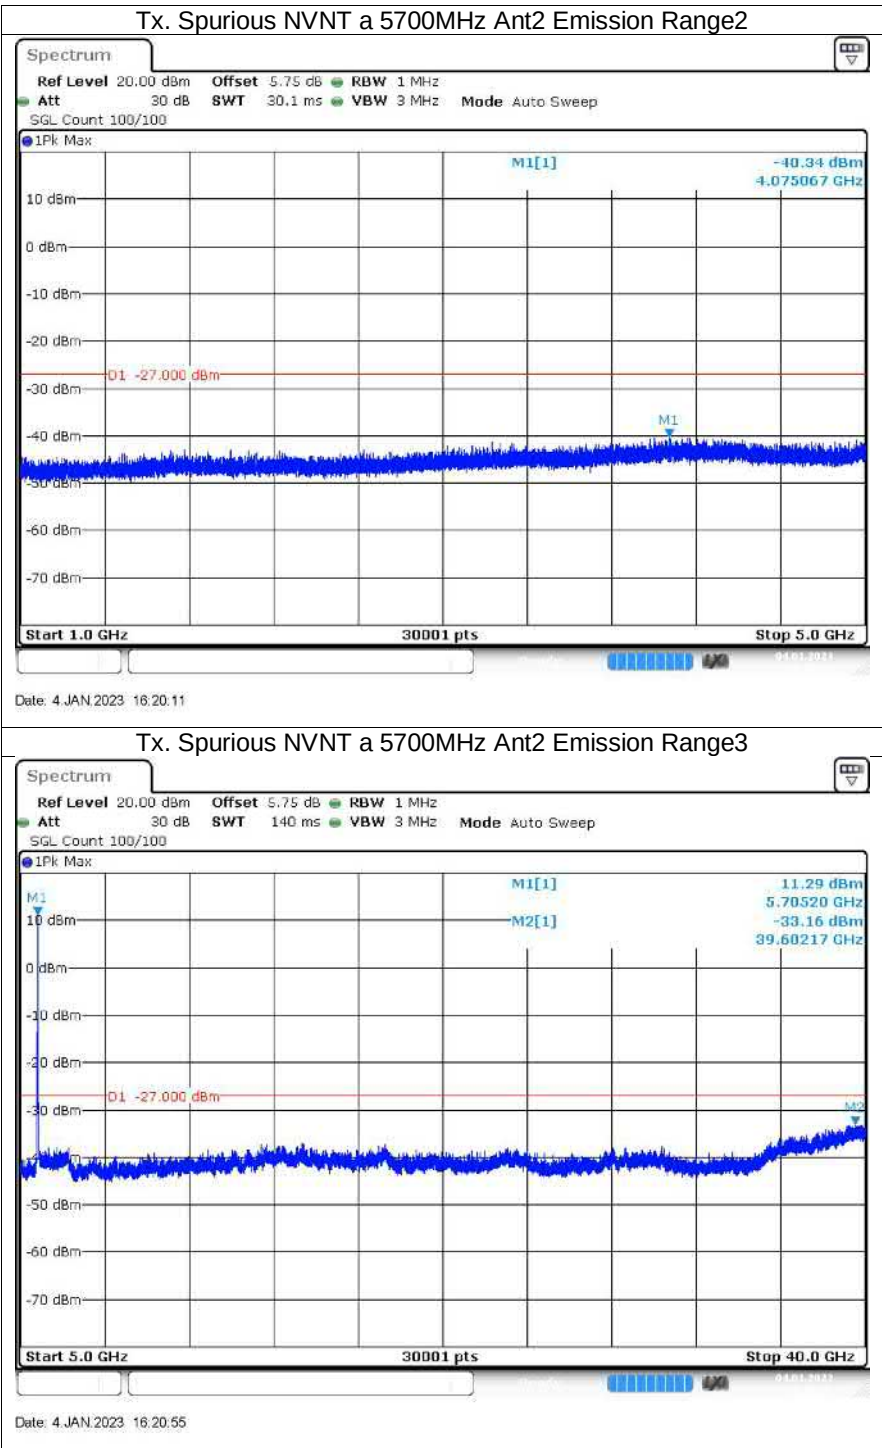


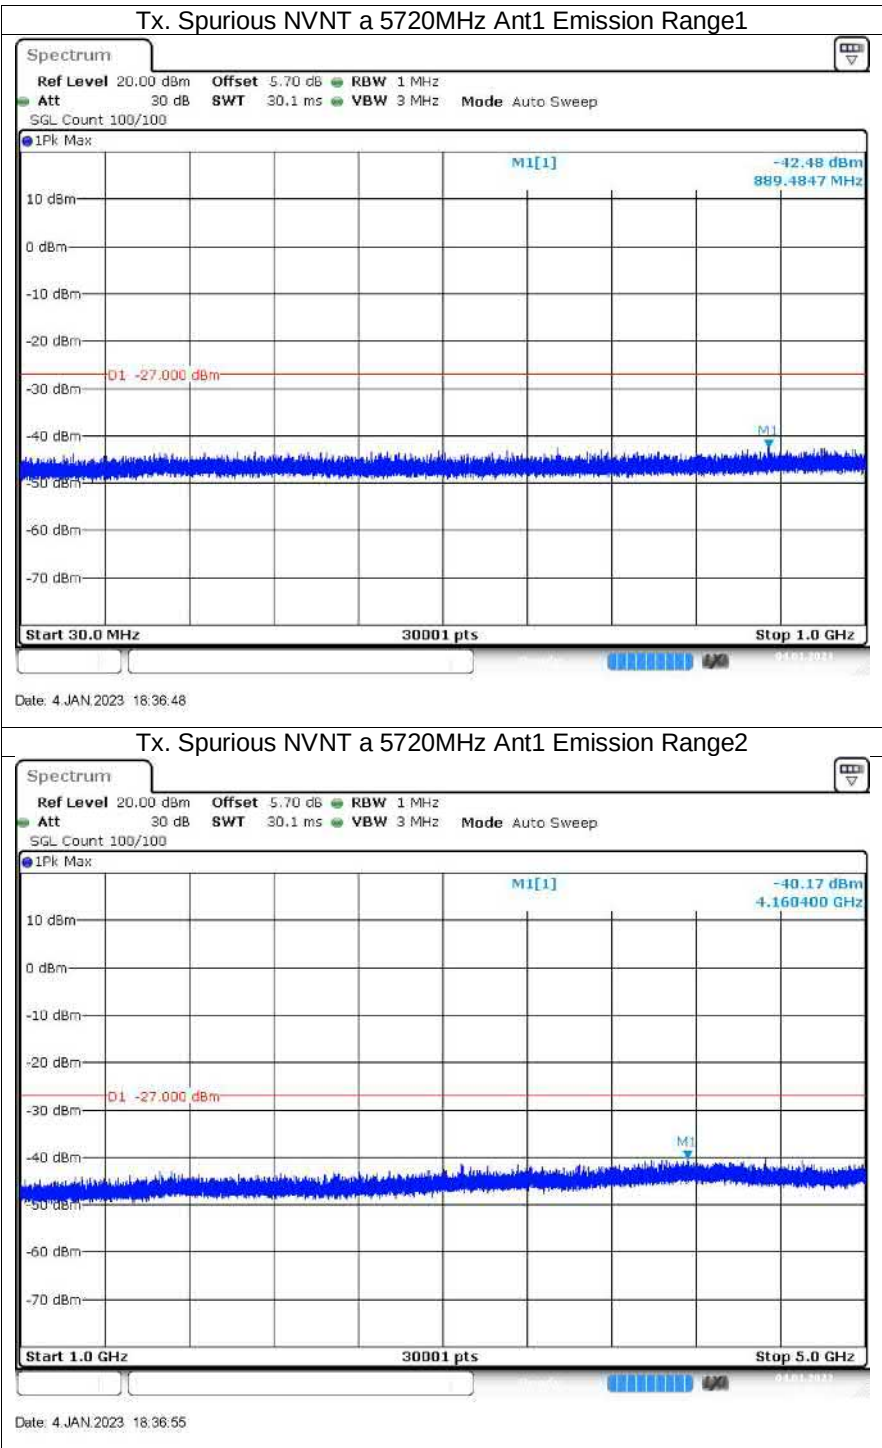


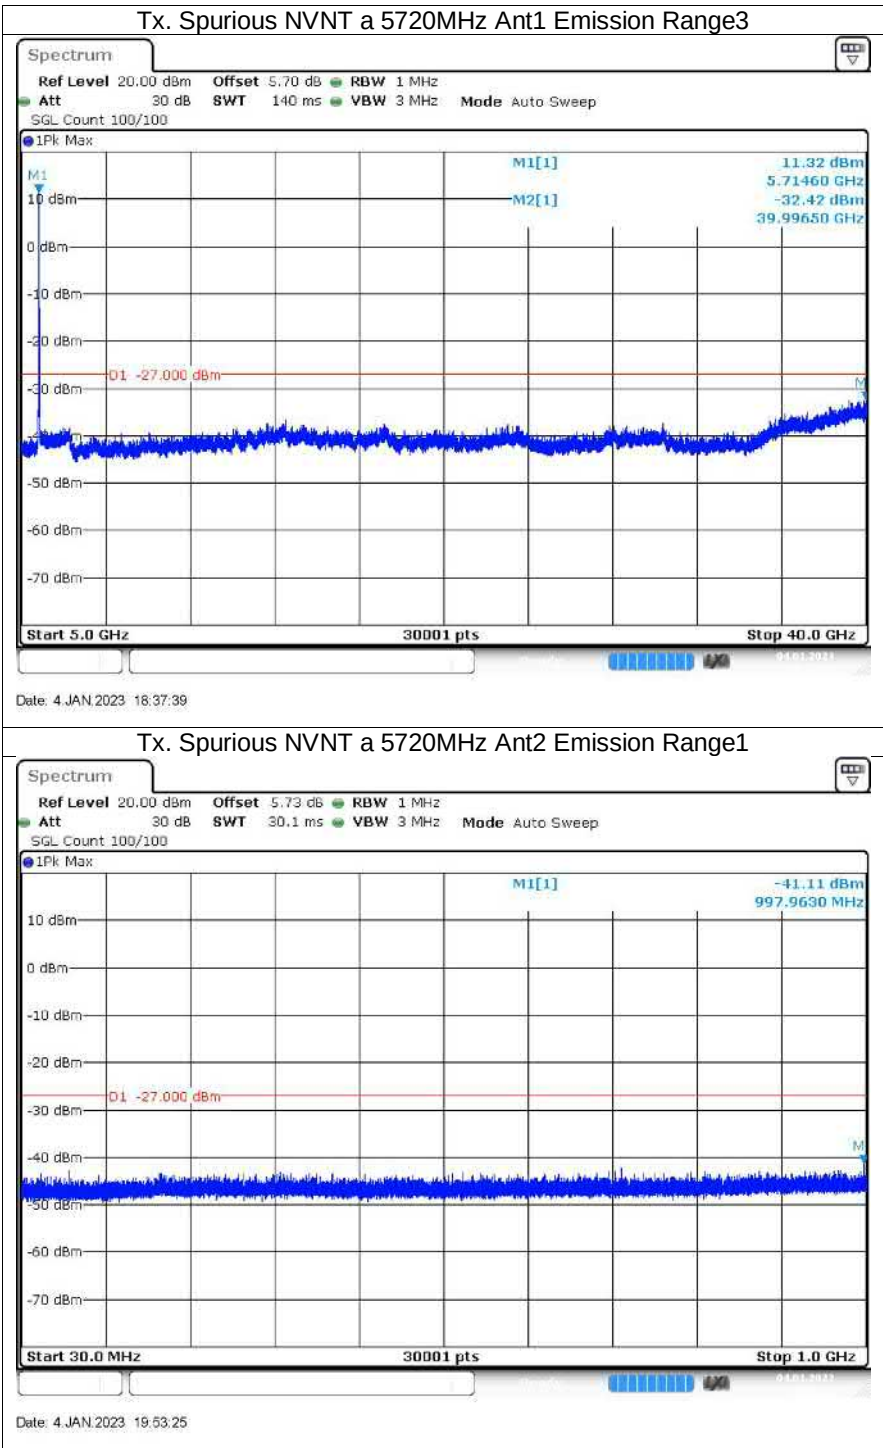


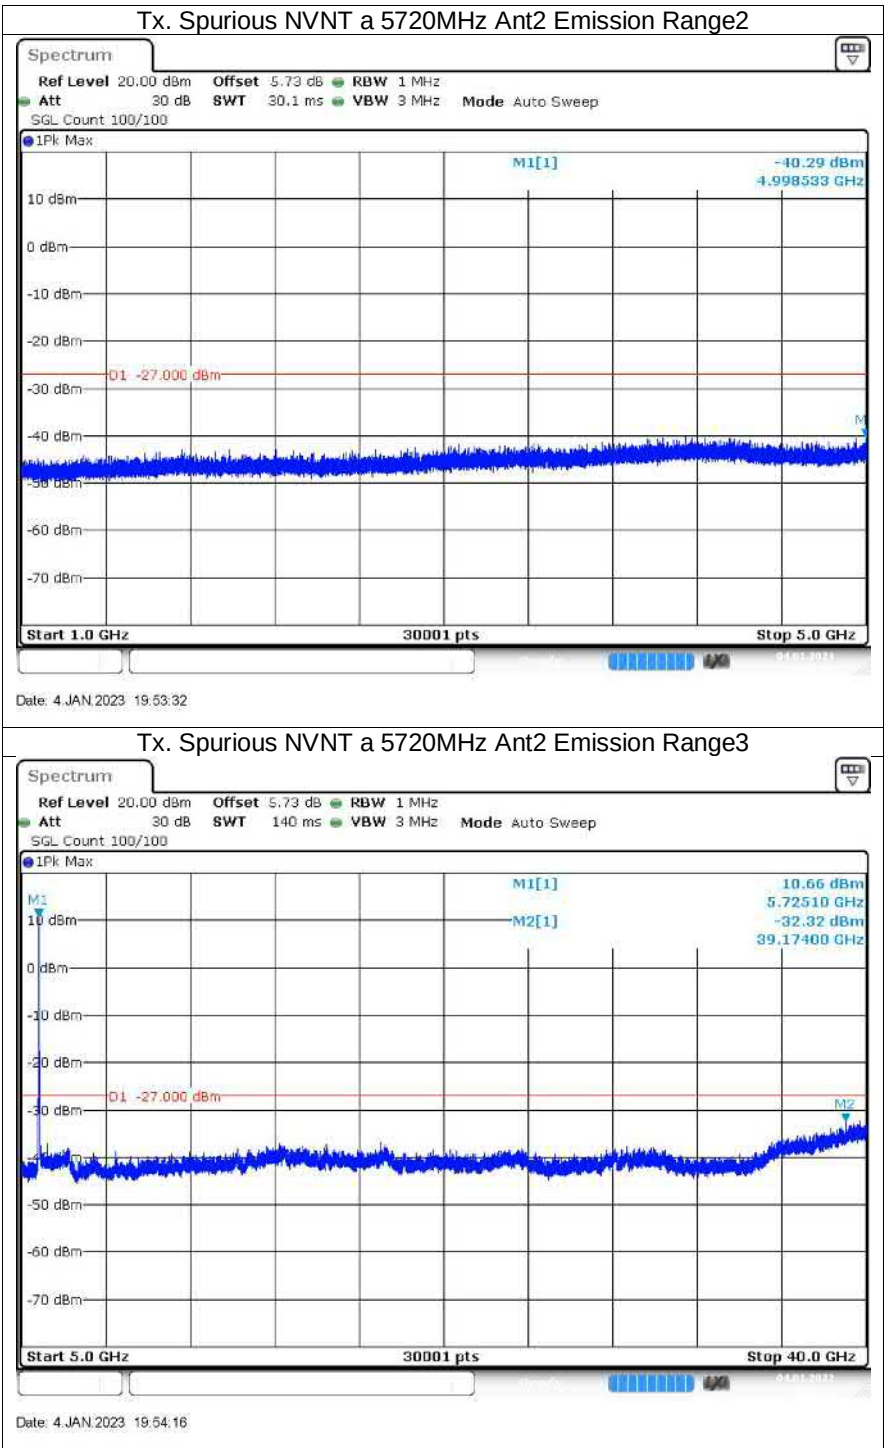


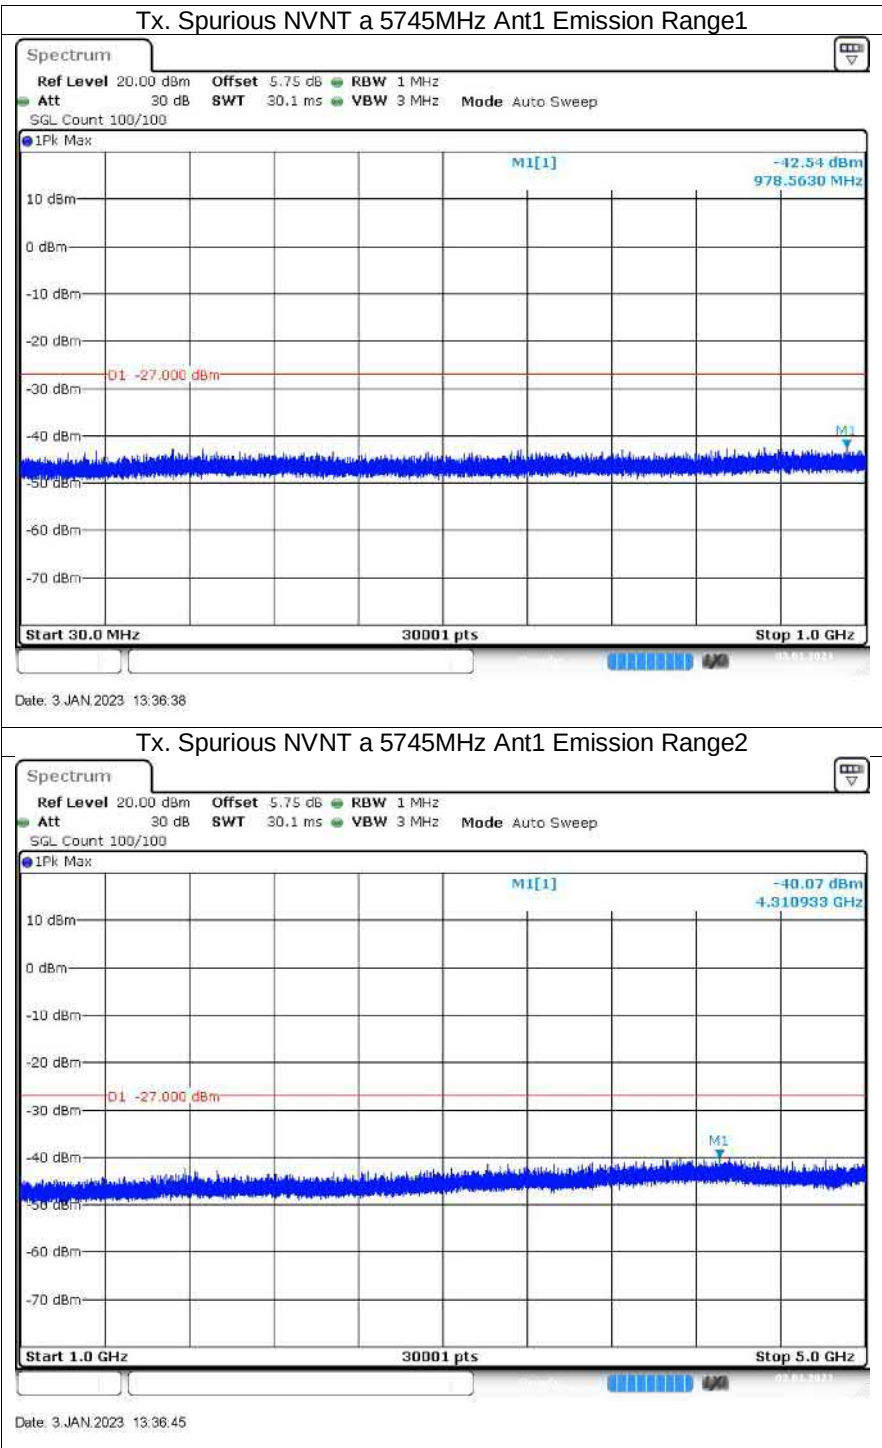


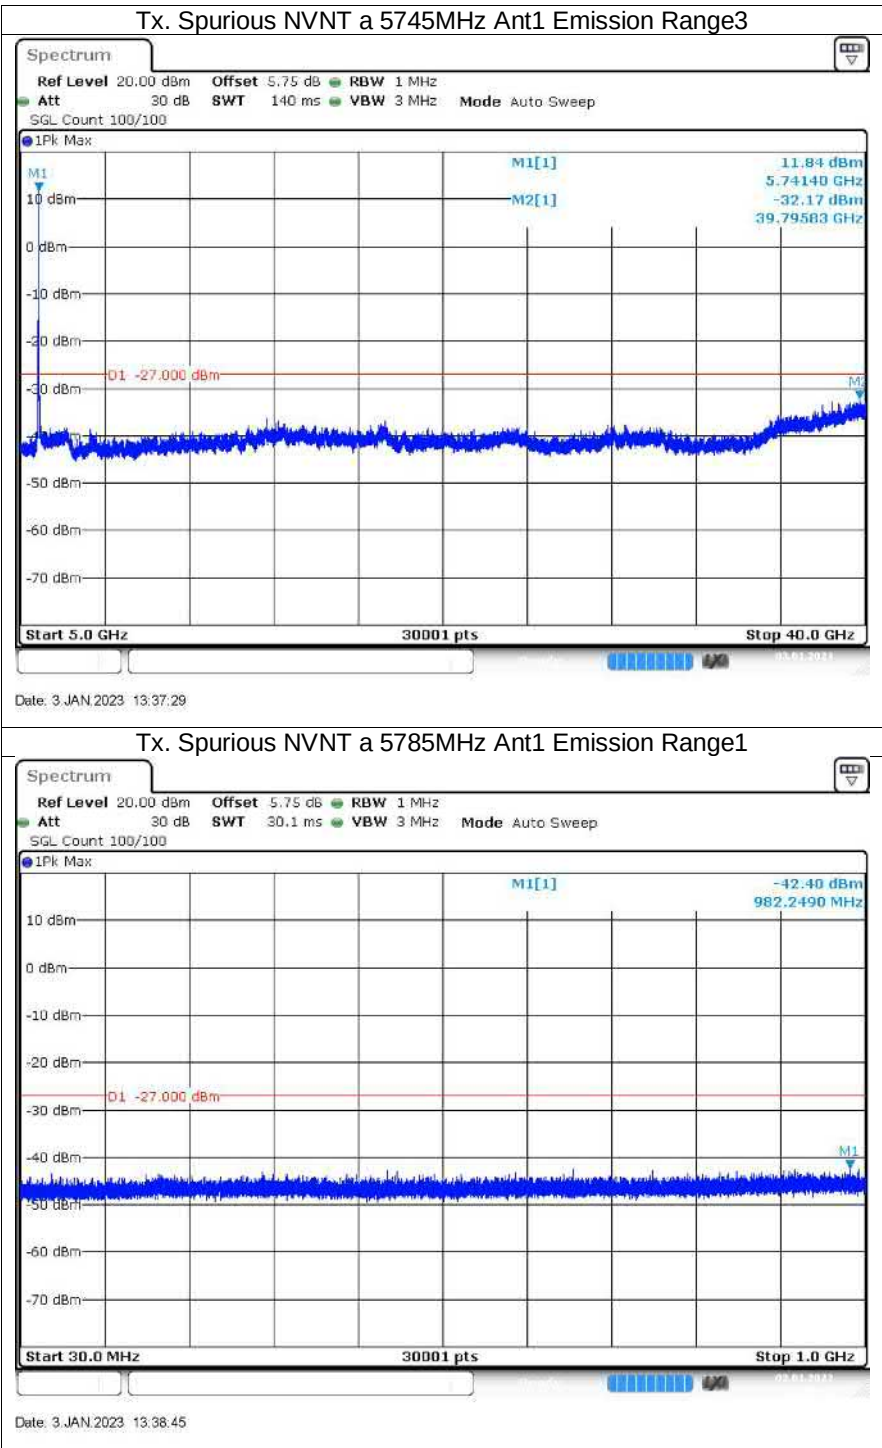


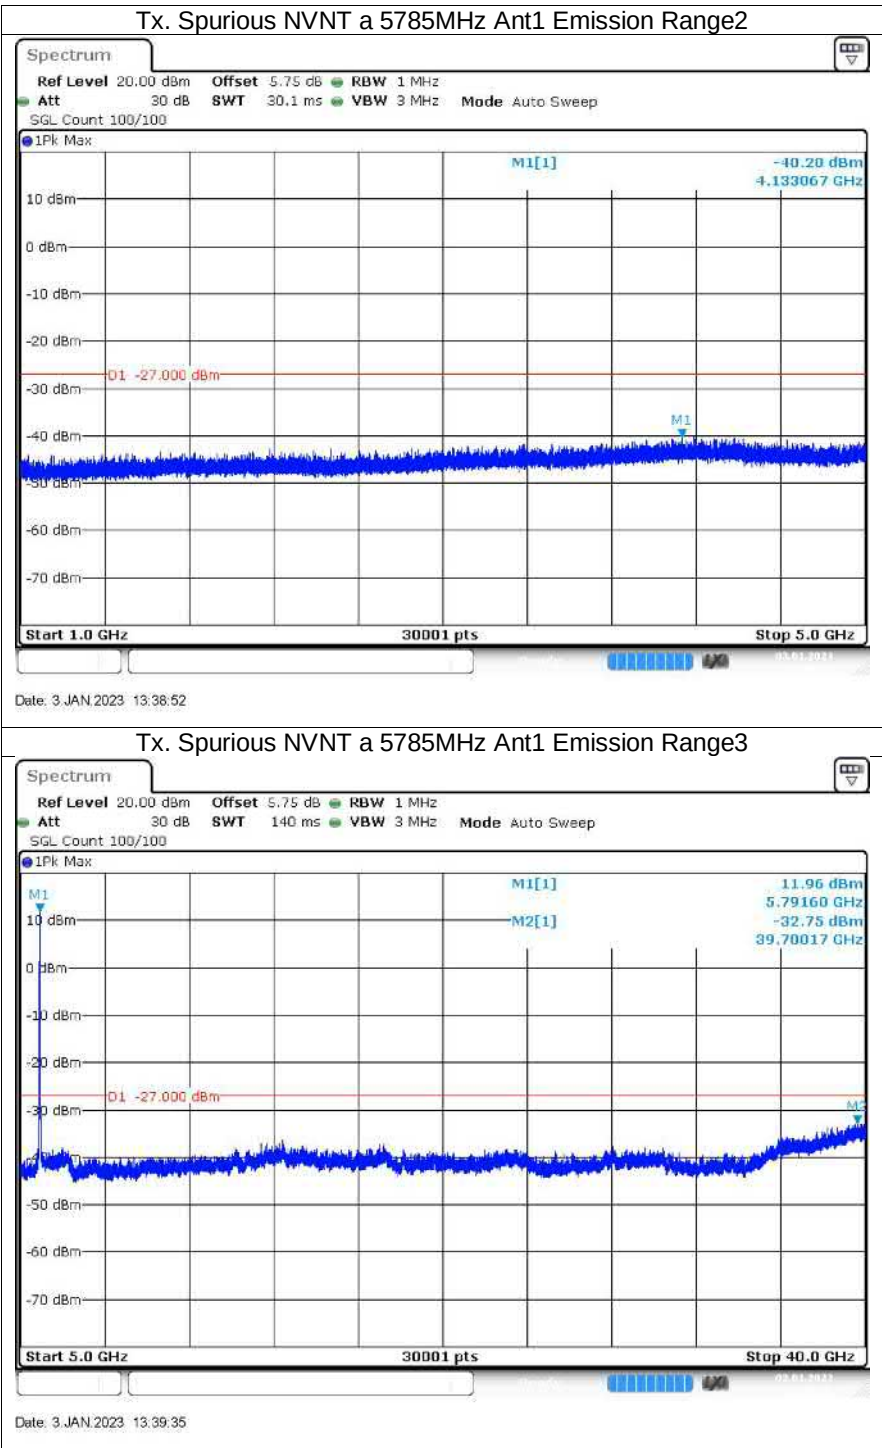


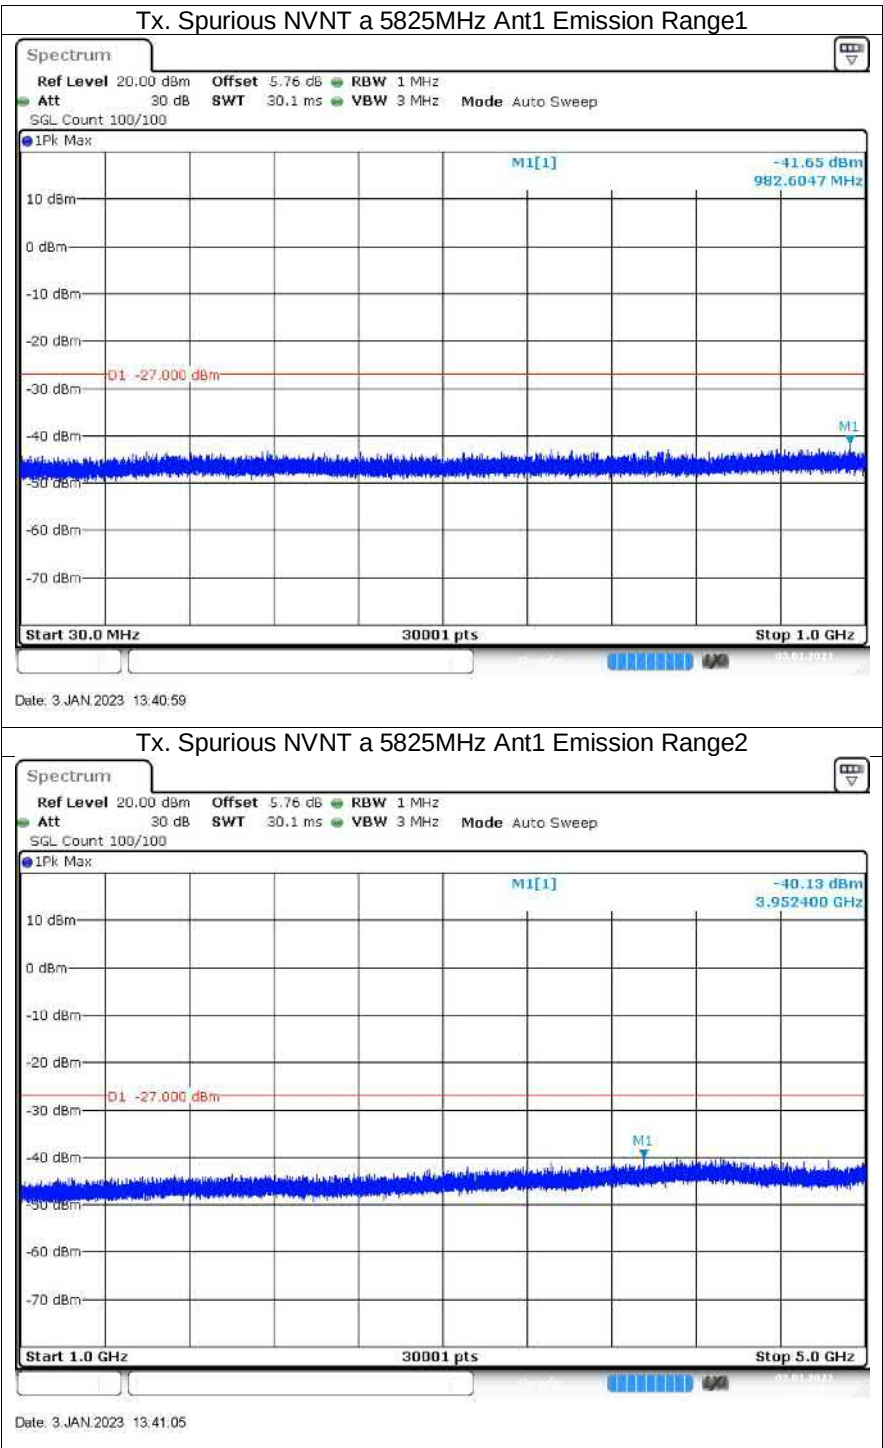


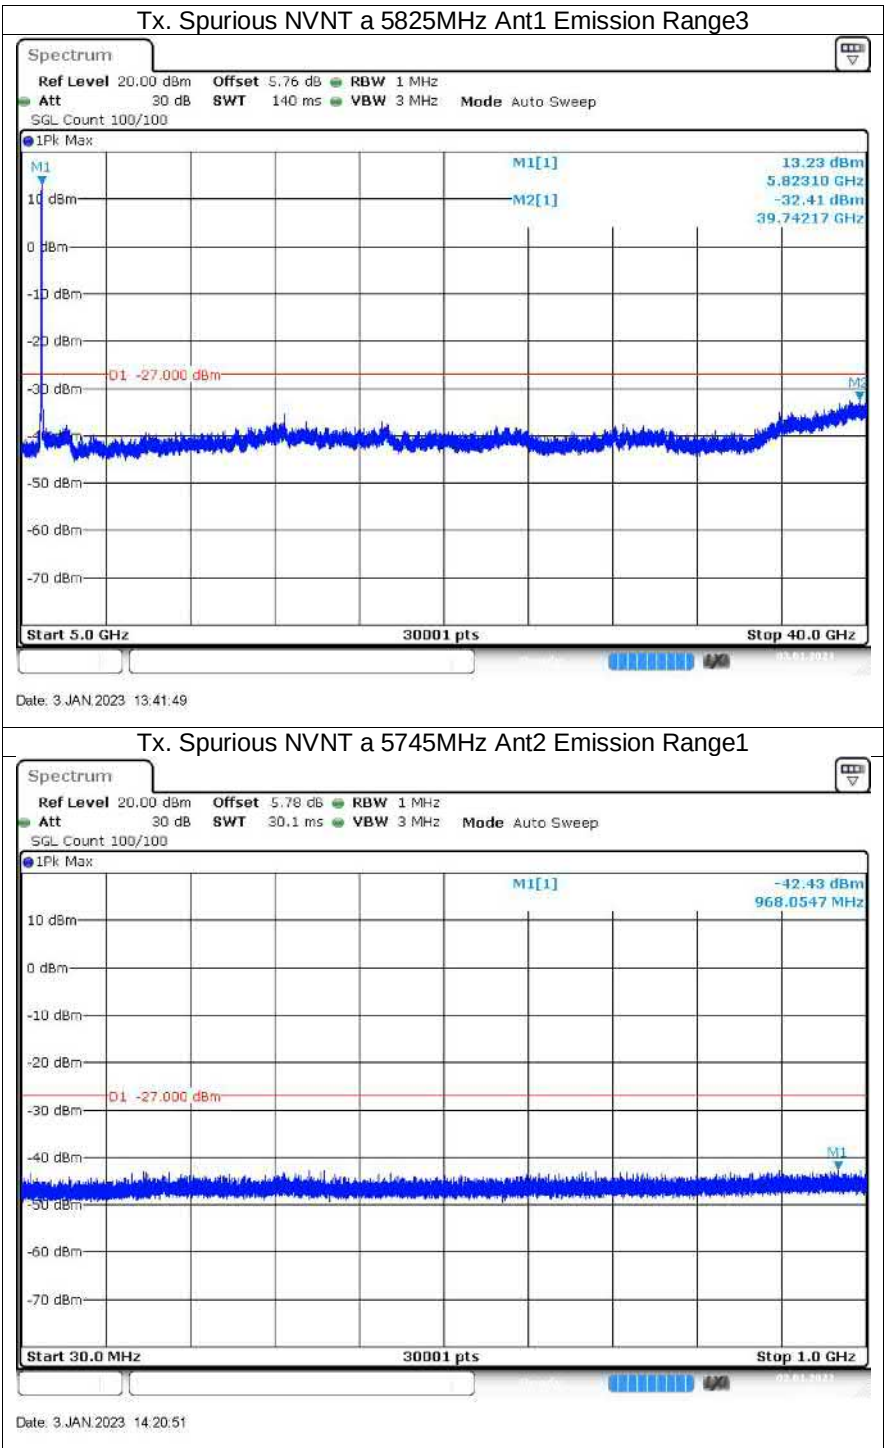


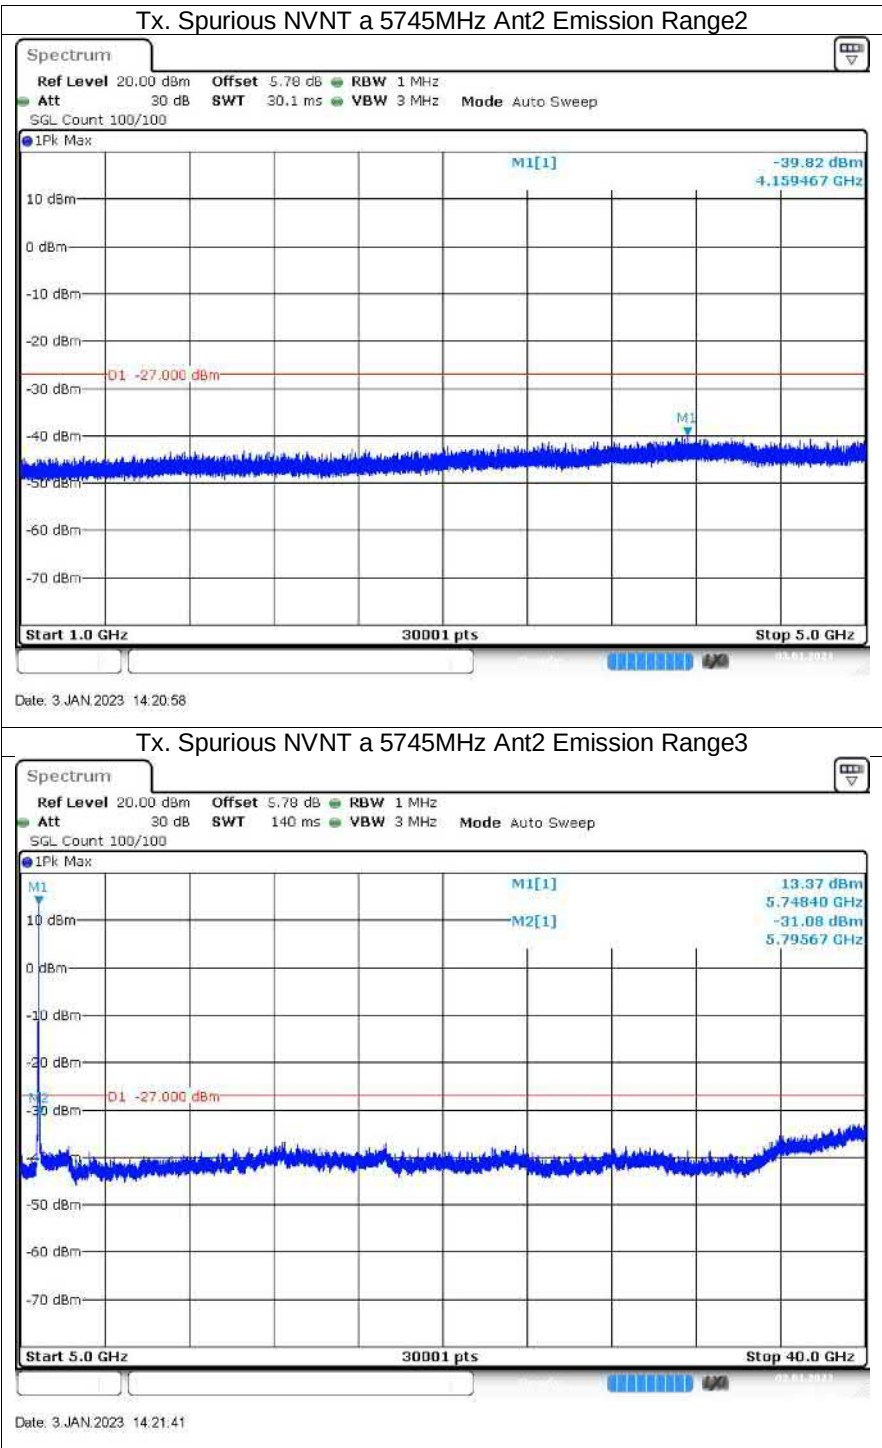


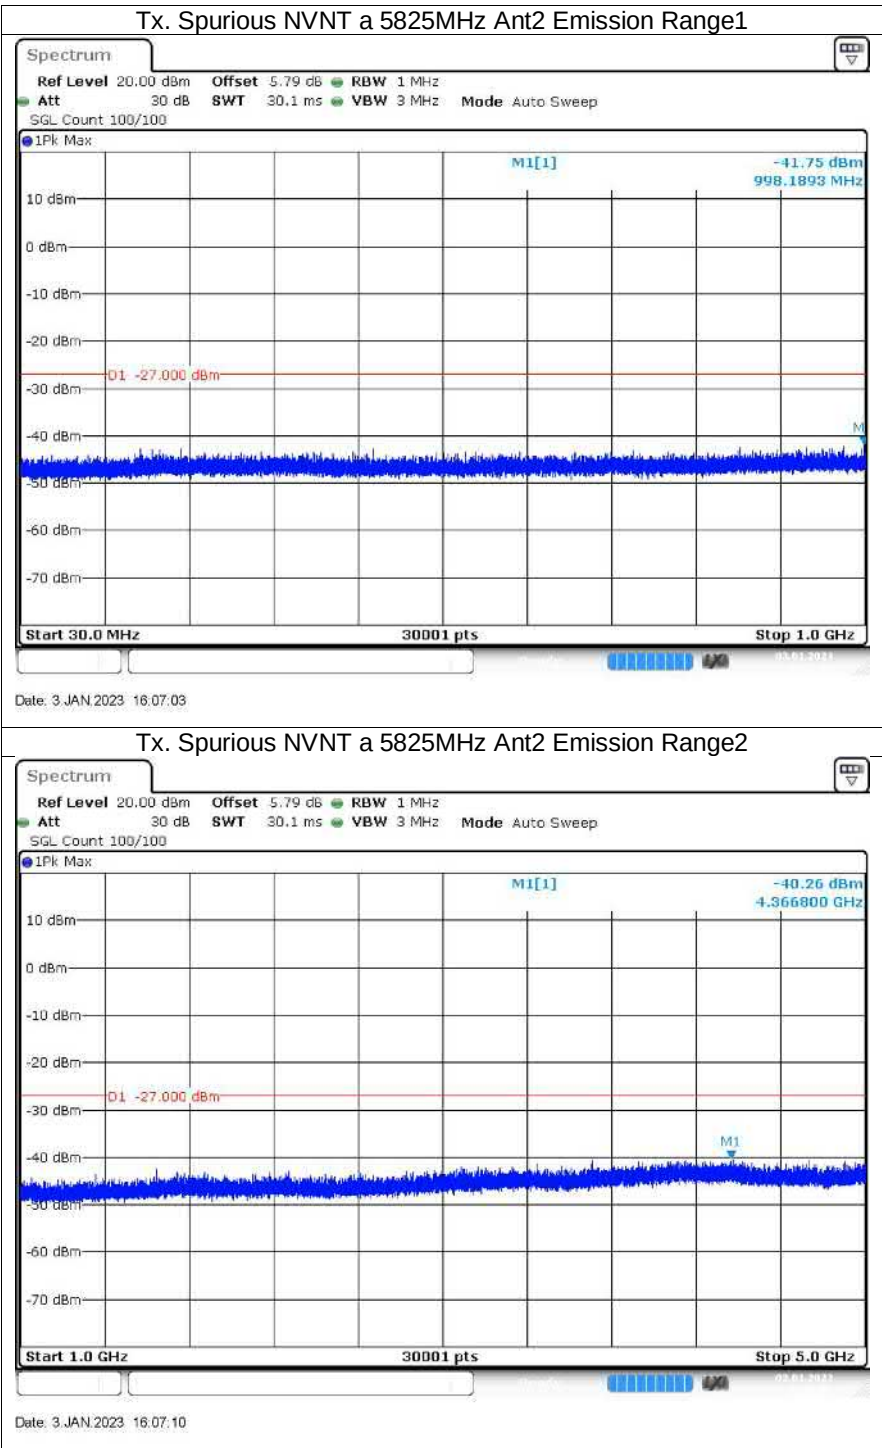


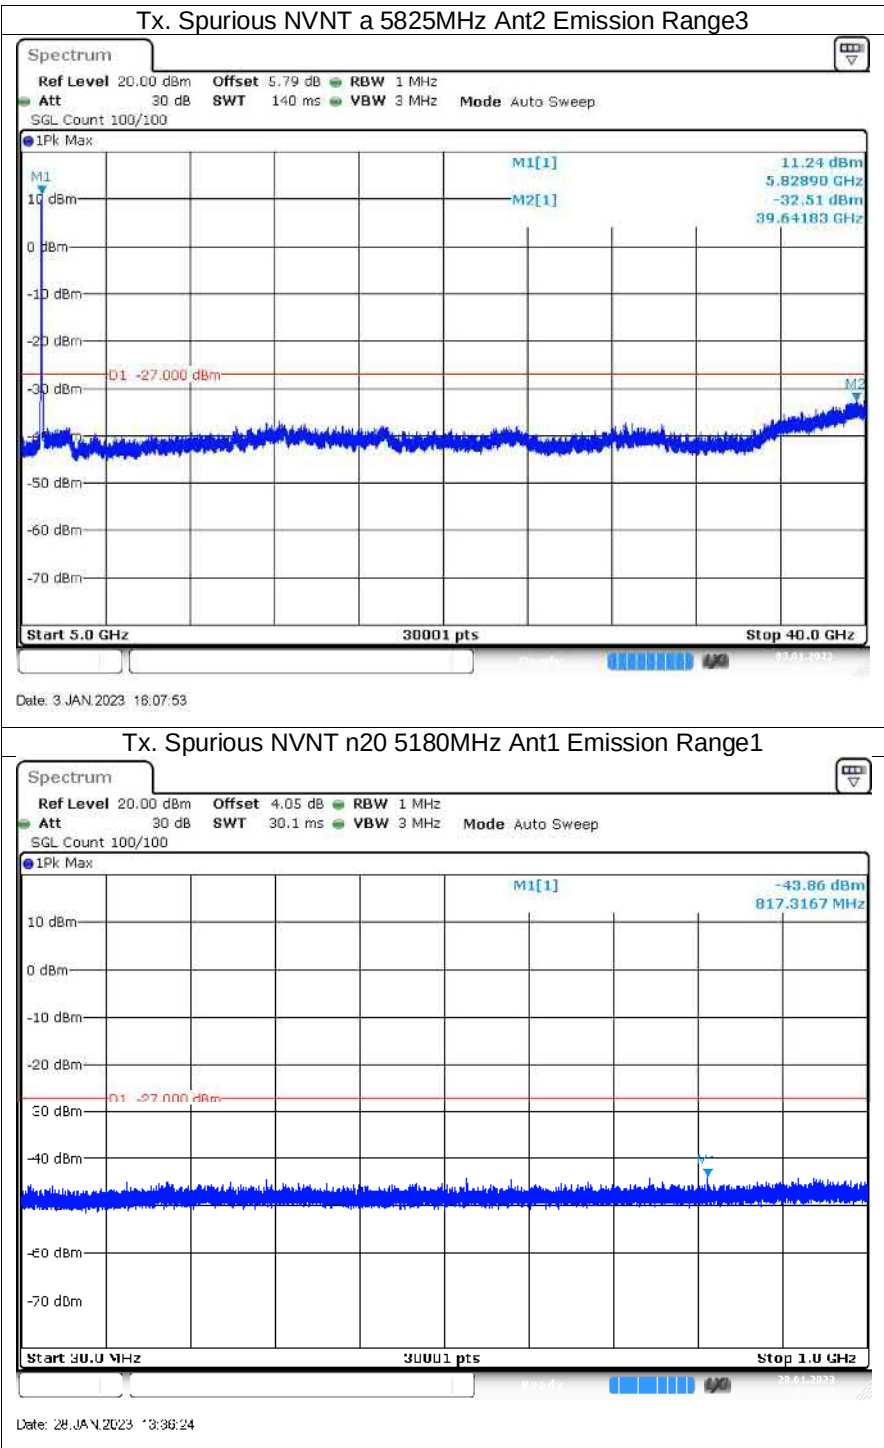


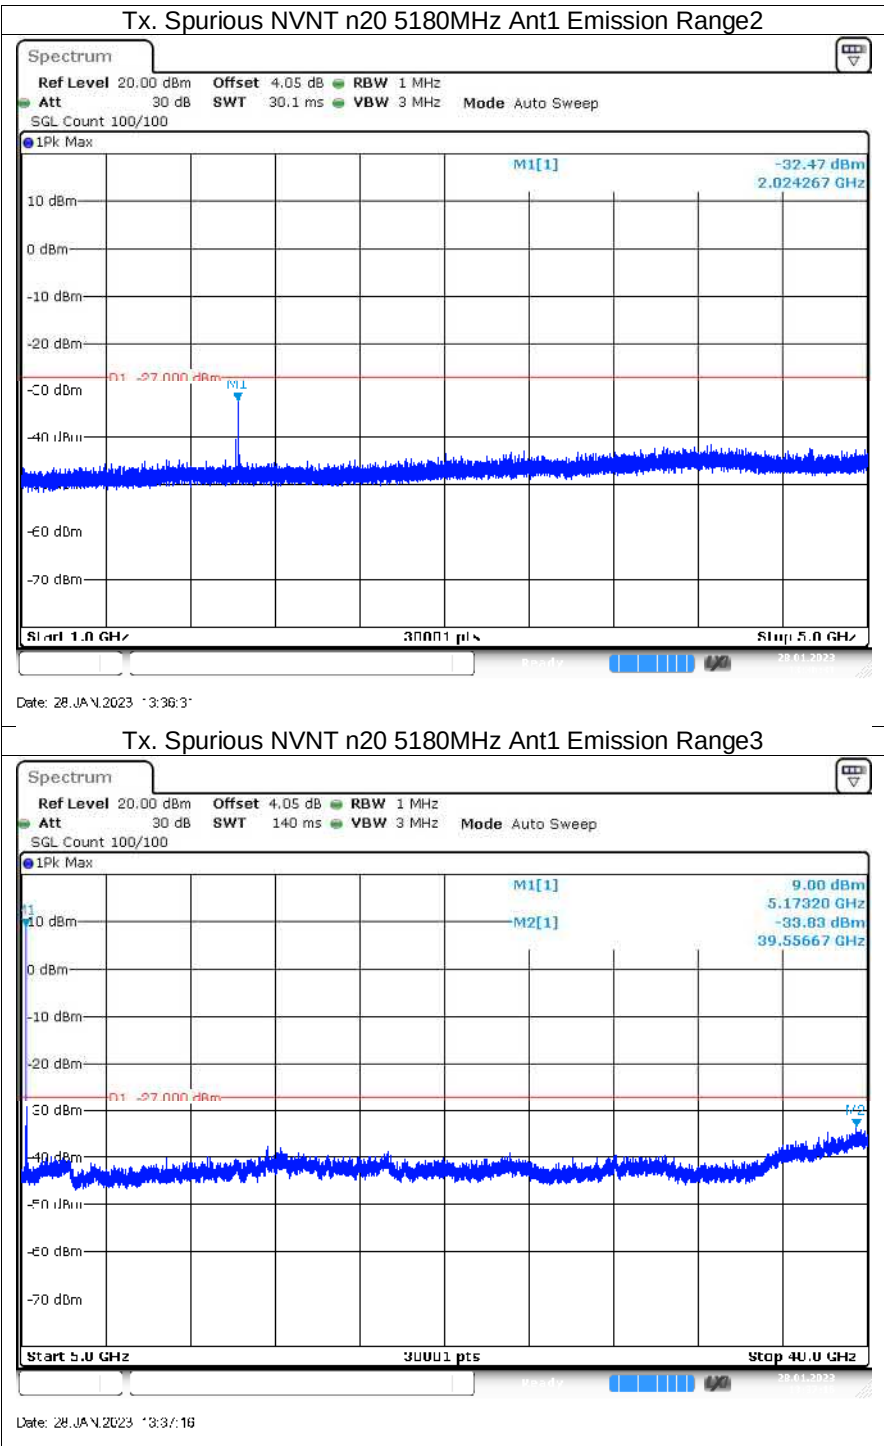


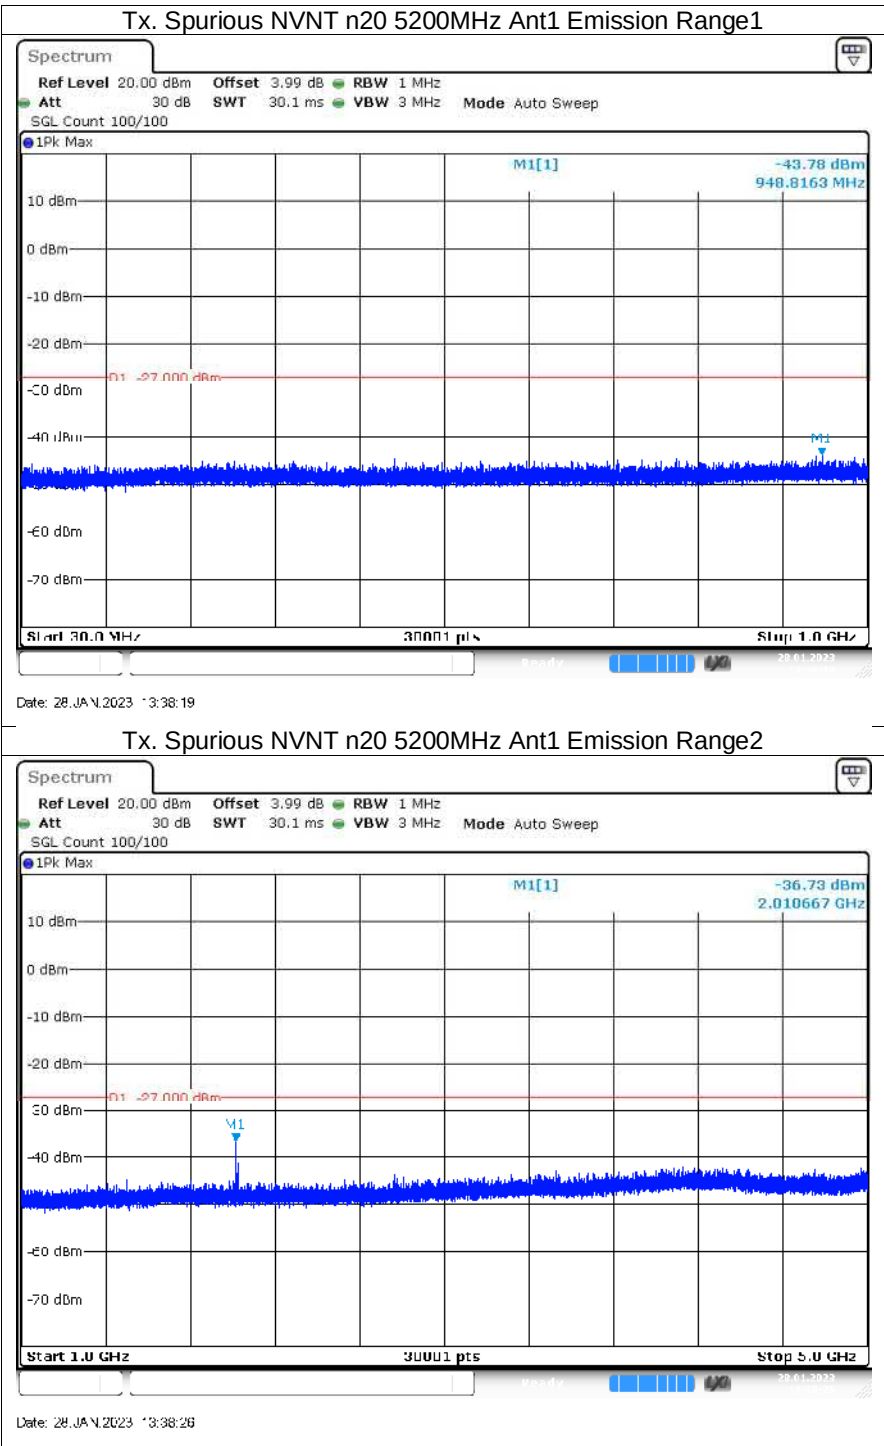


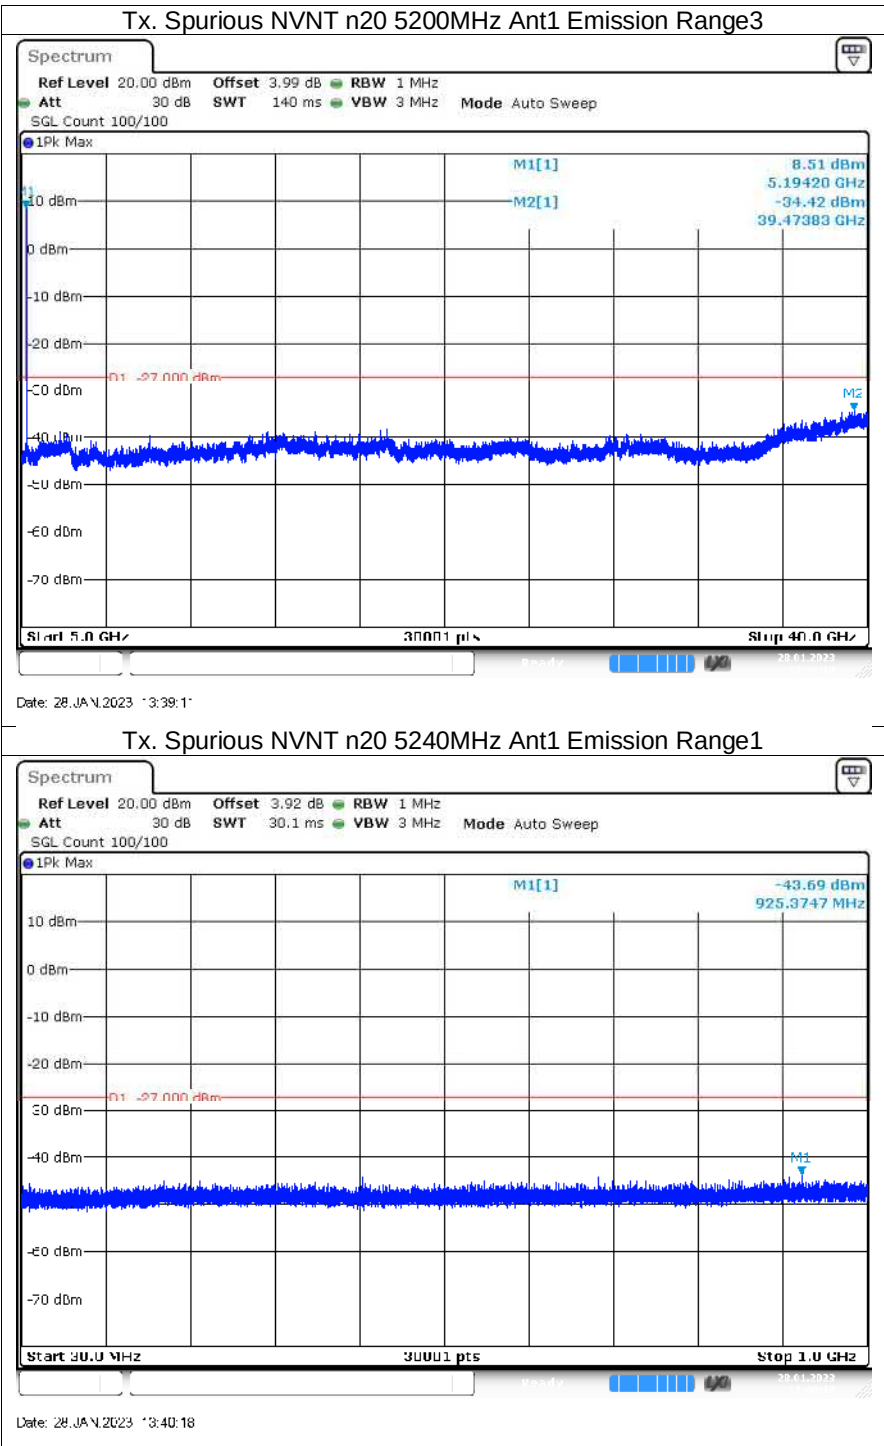


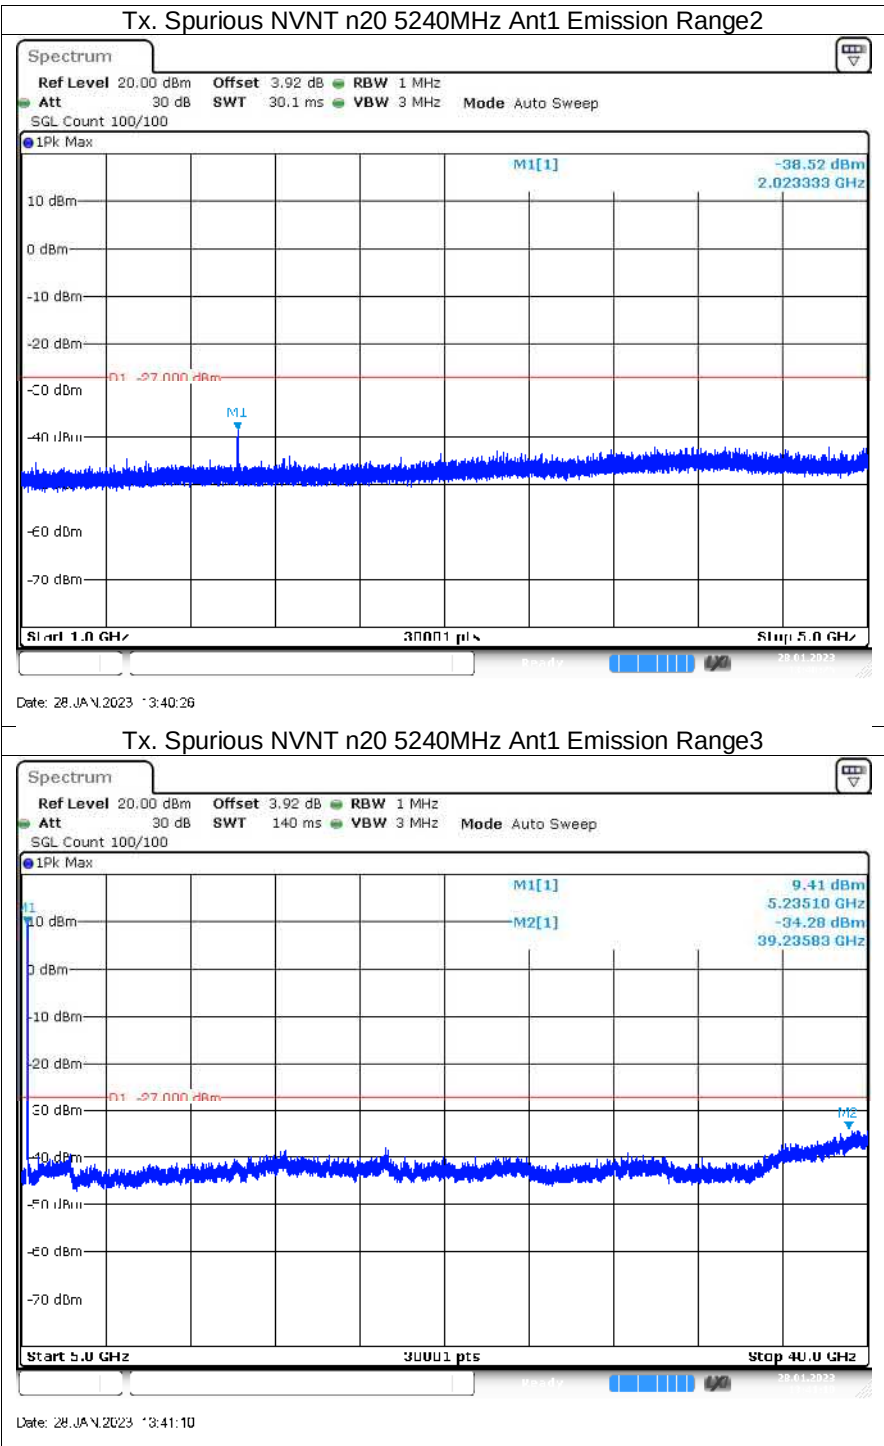

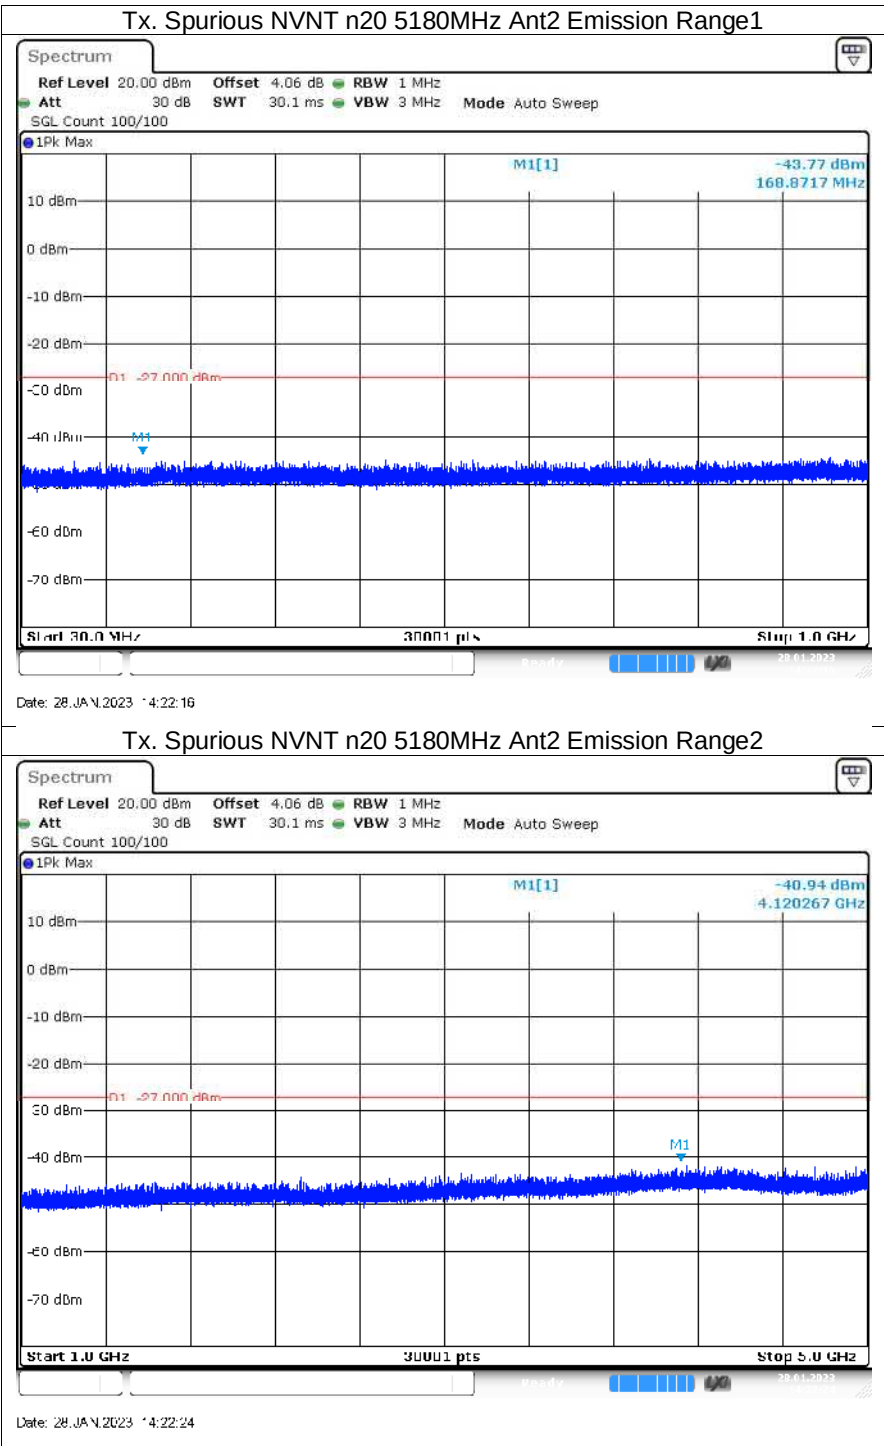

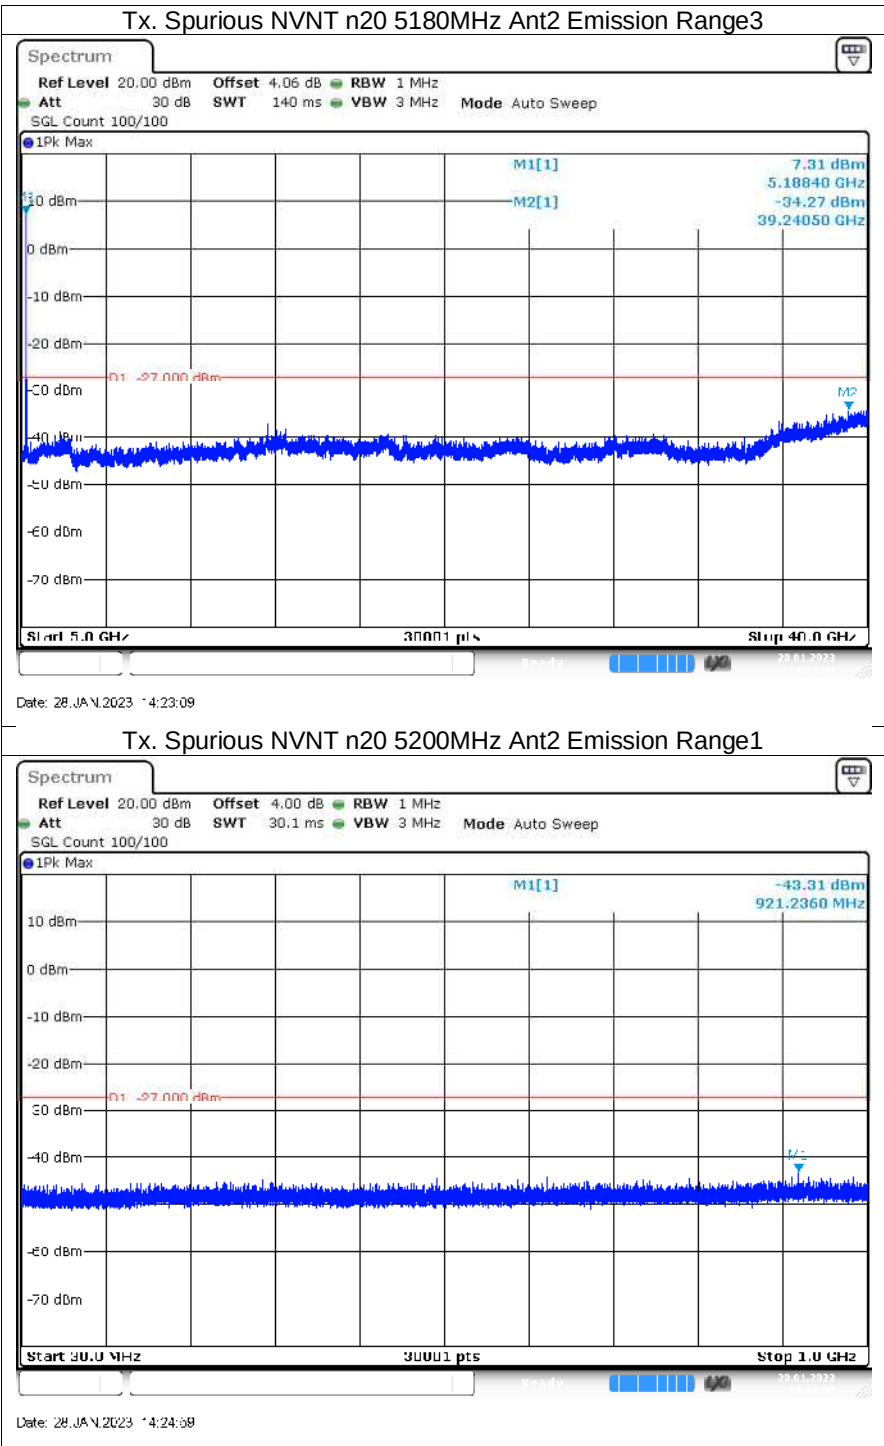


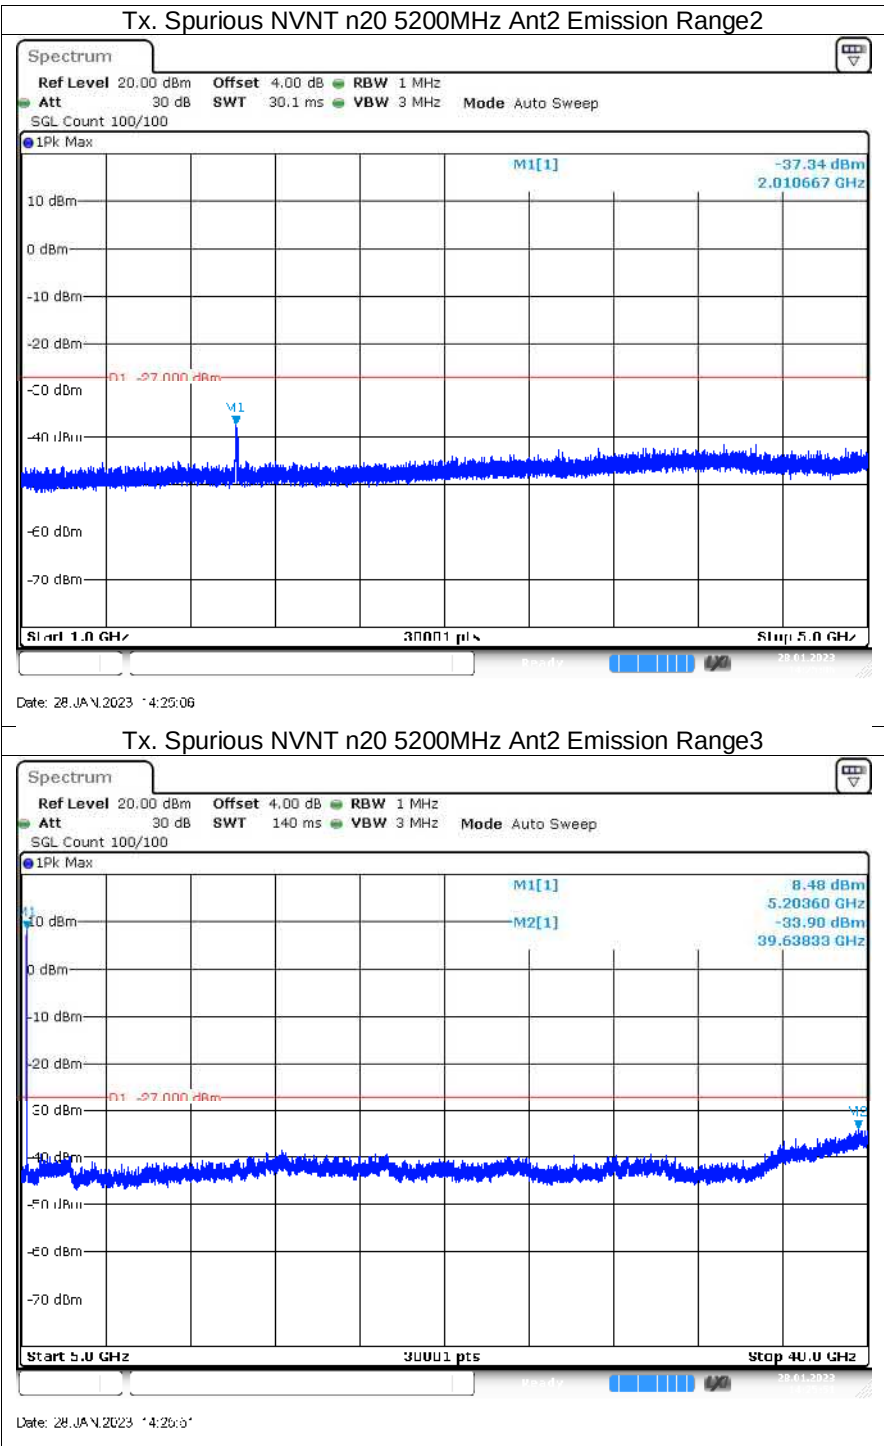


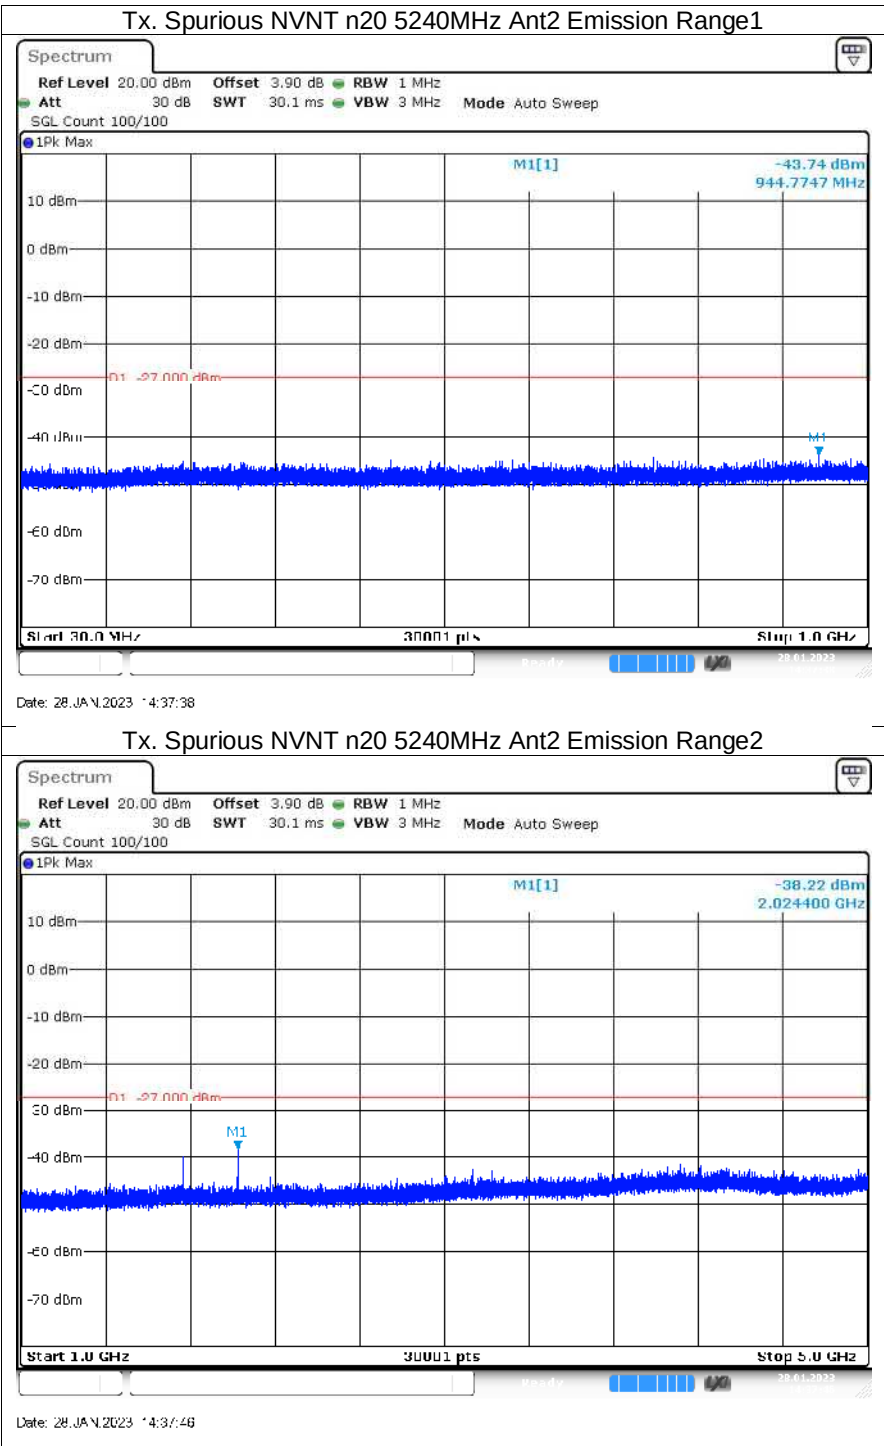




China

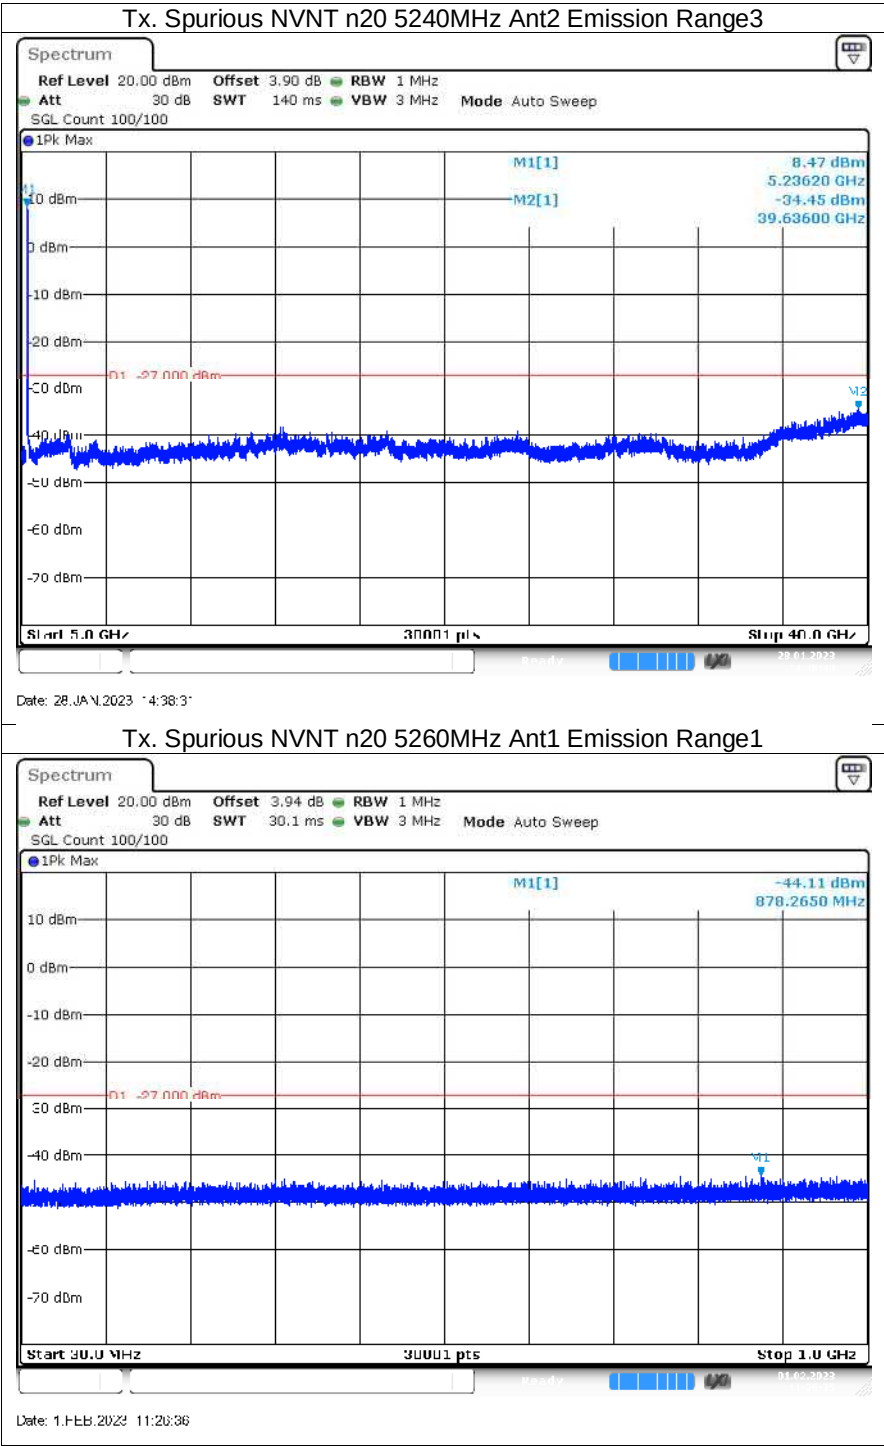


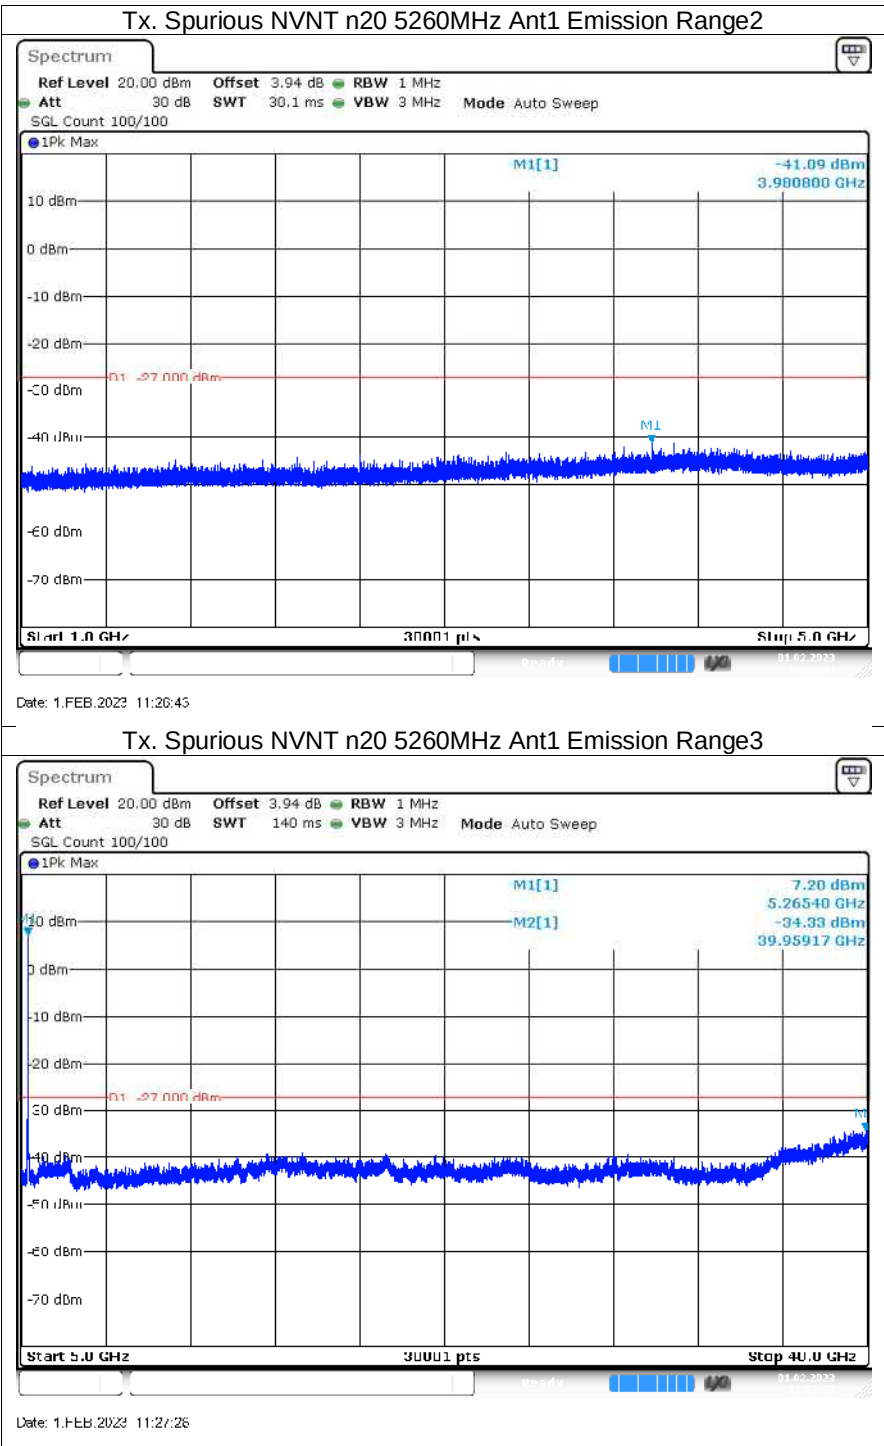




China

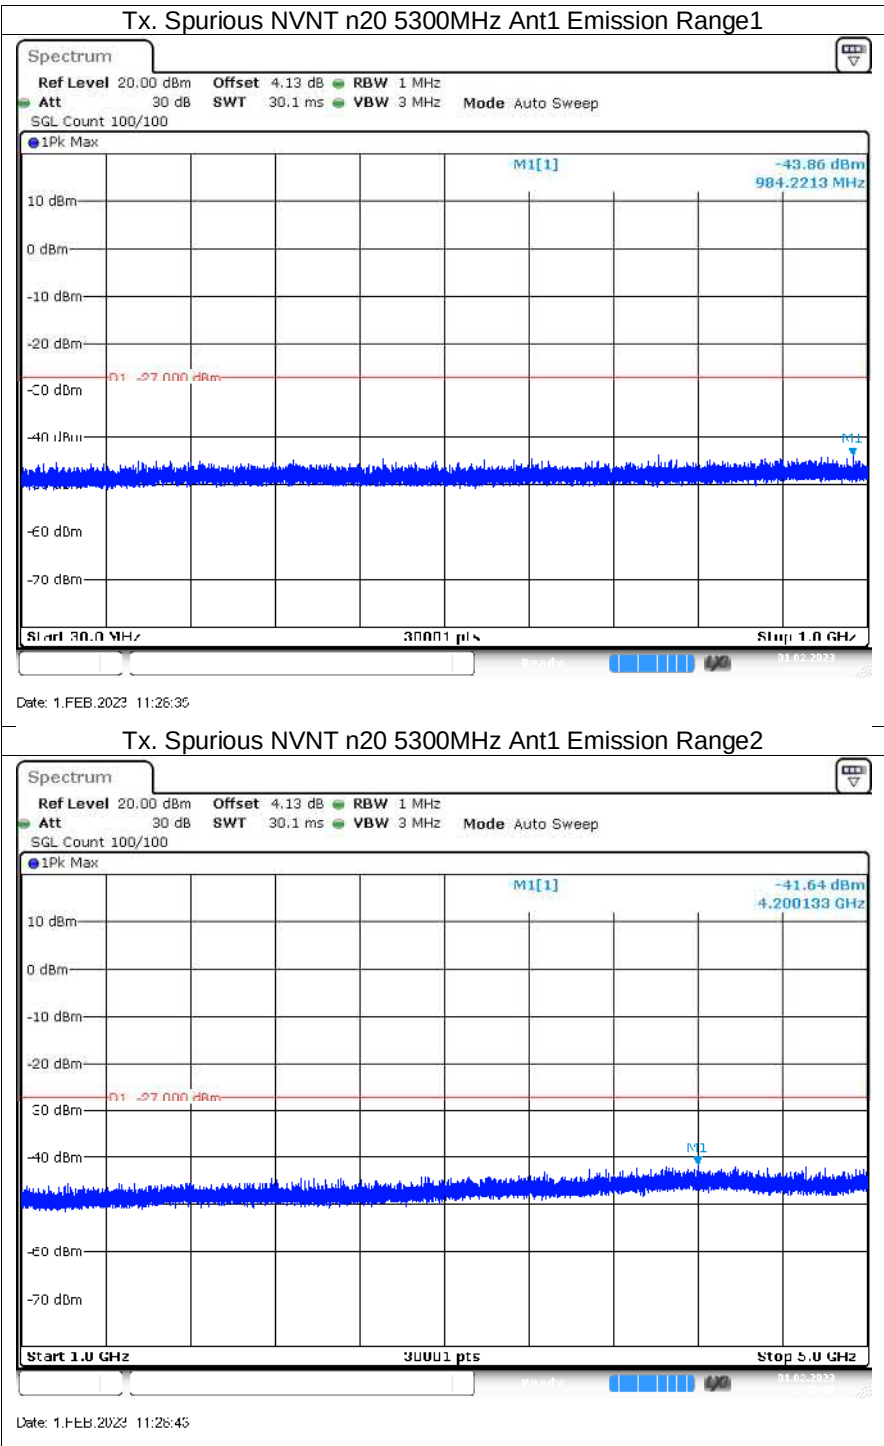


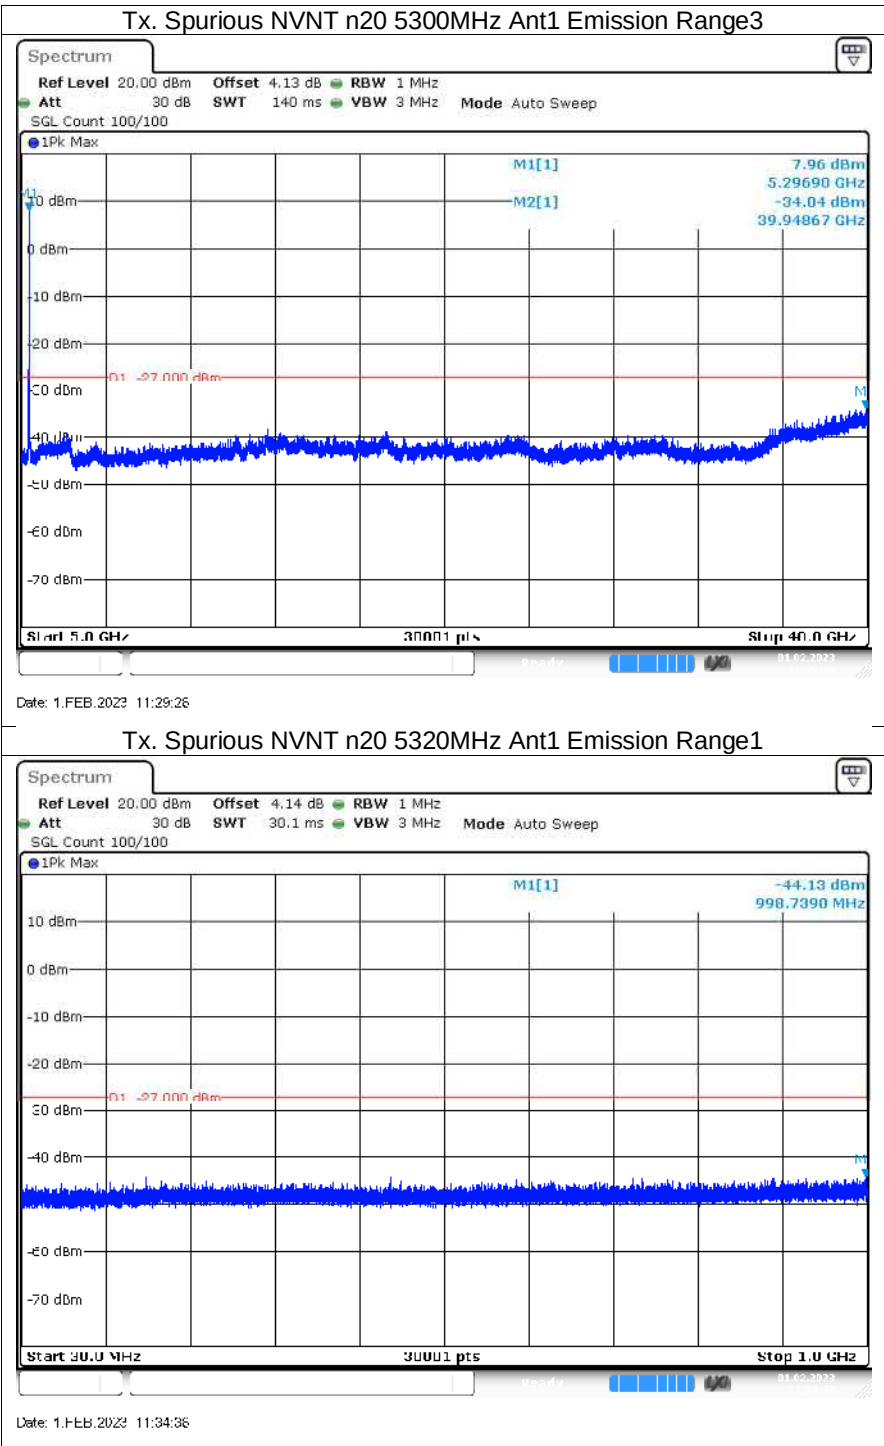






China


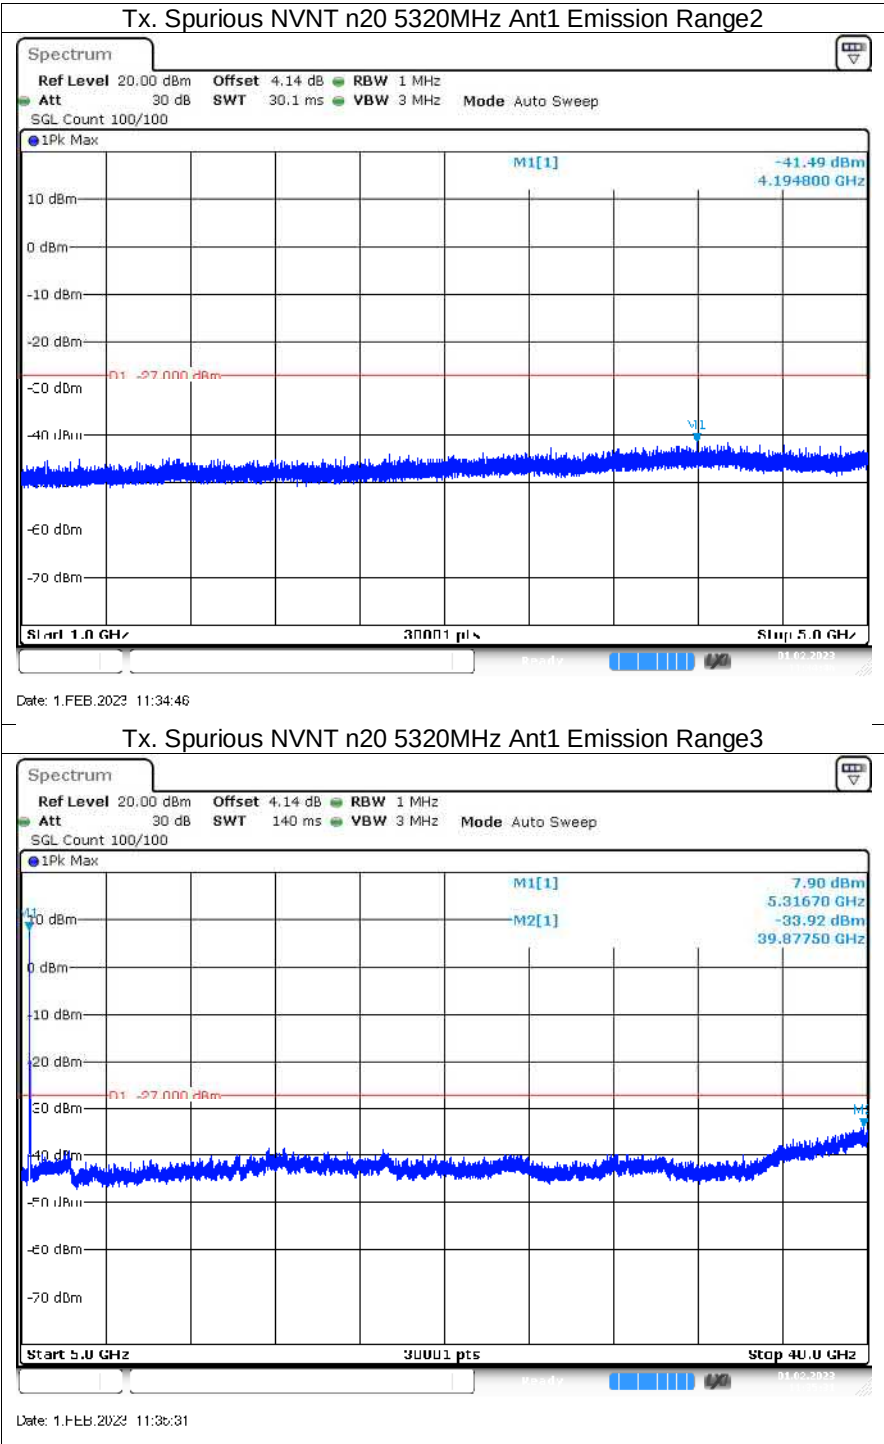


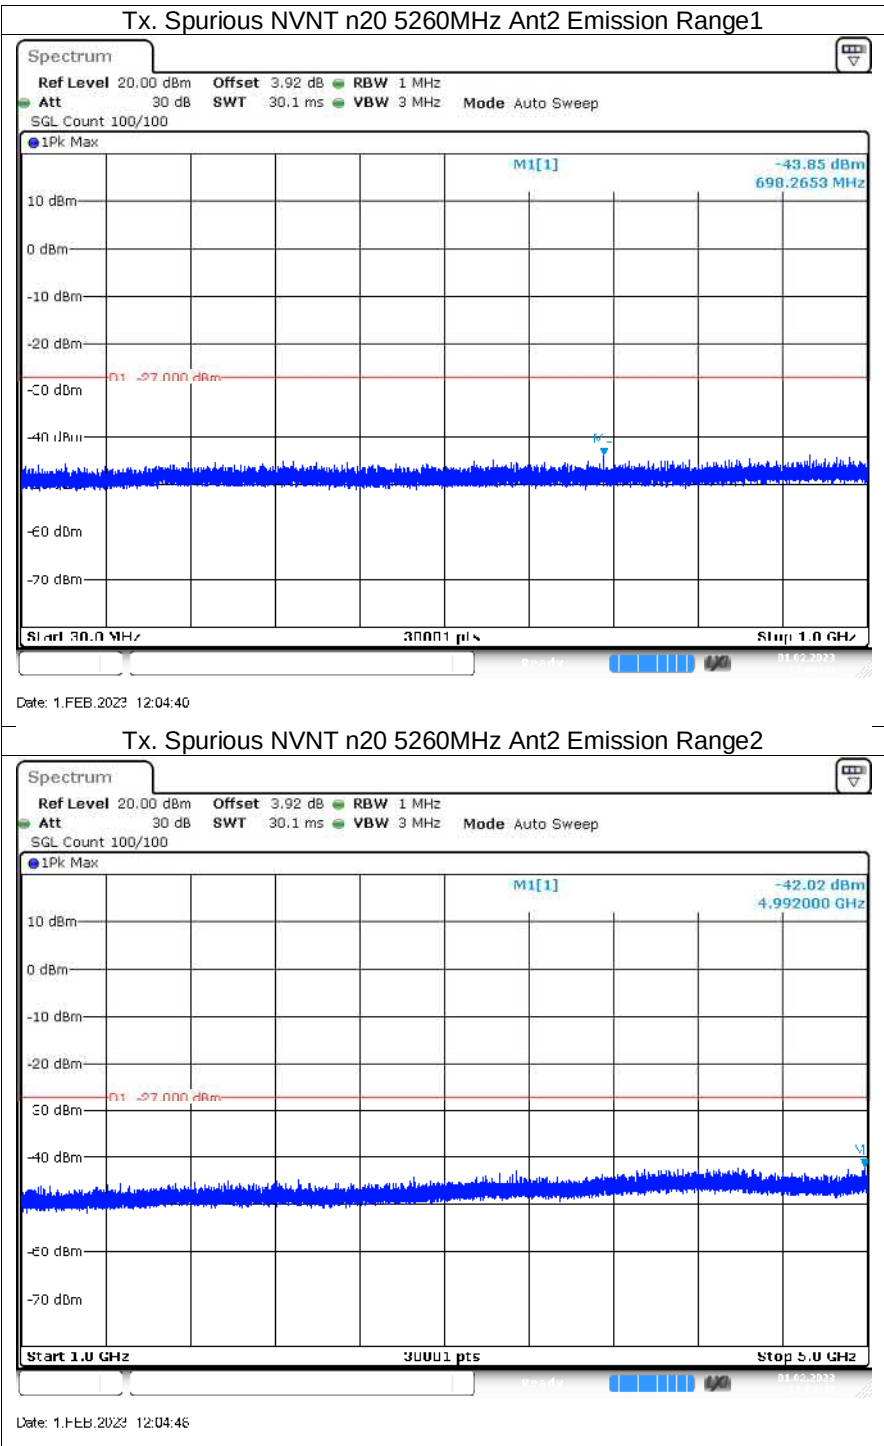


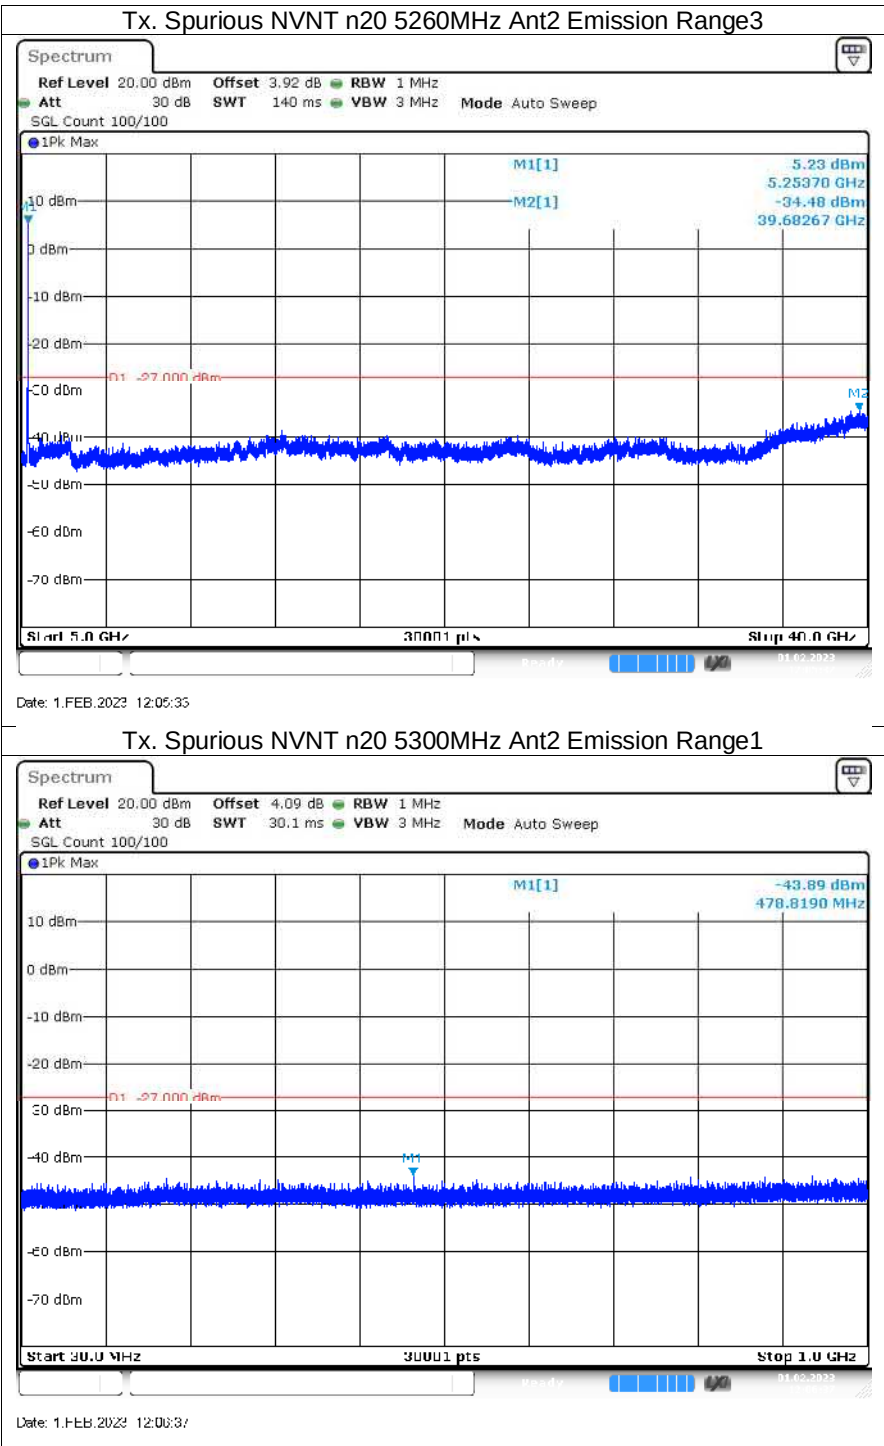


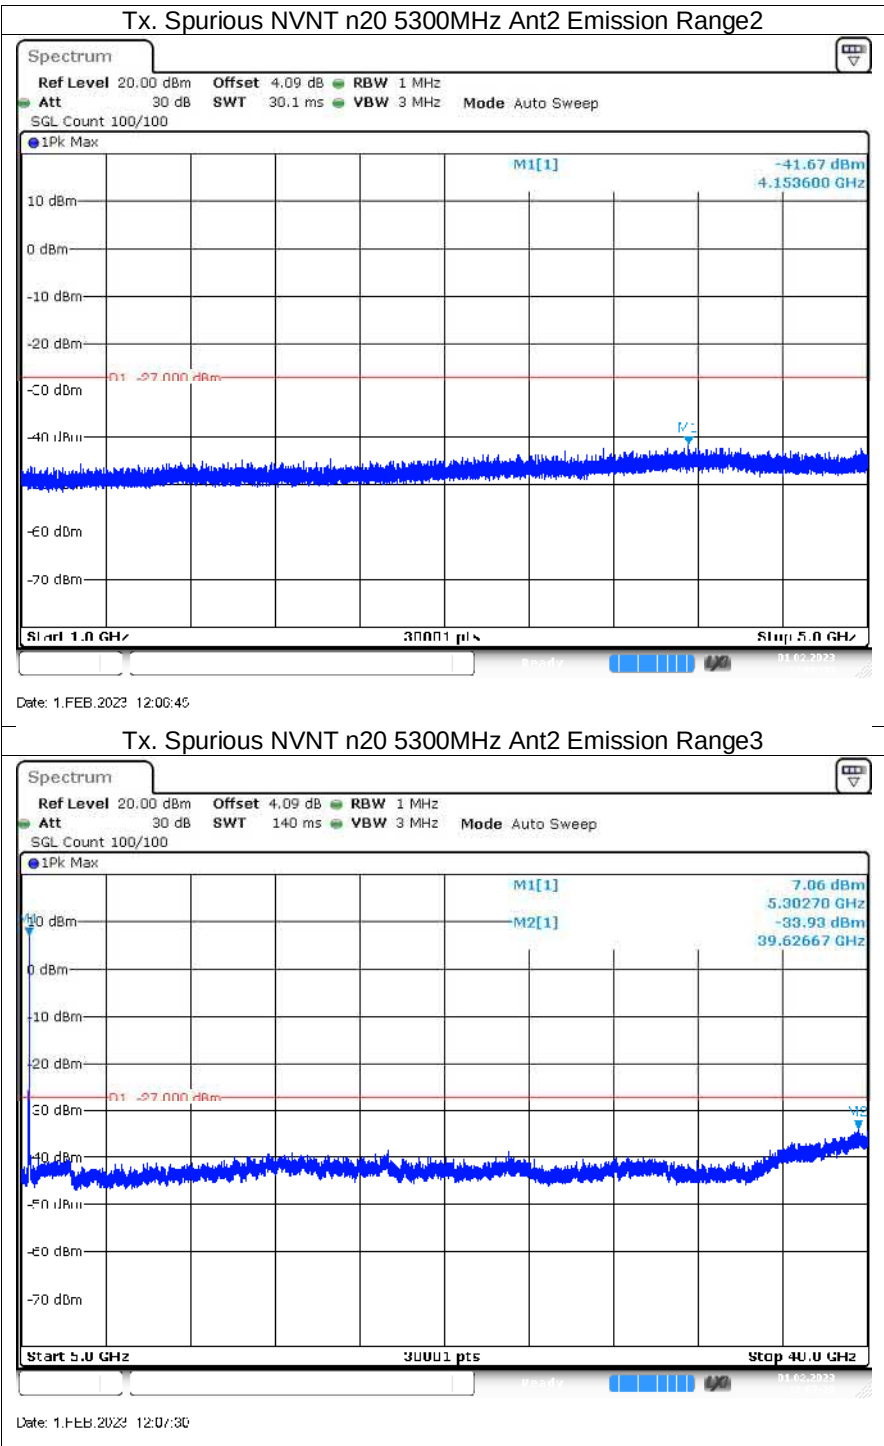


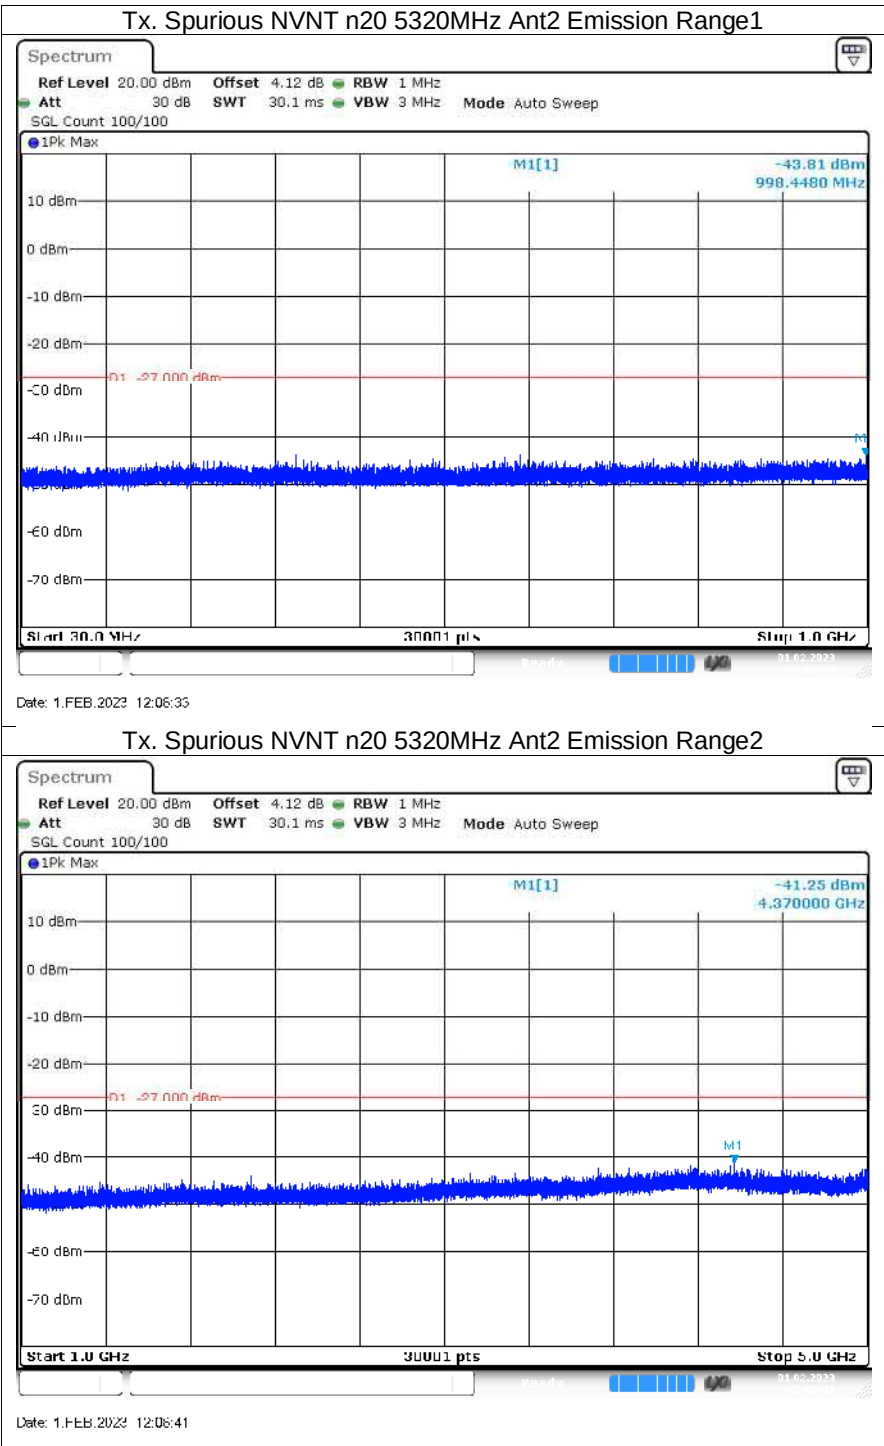


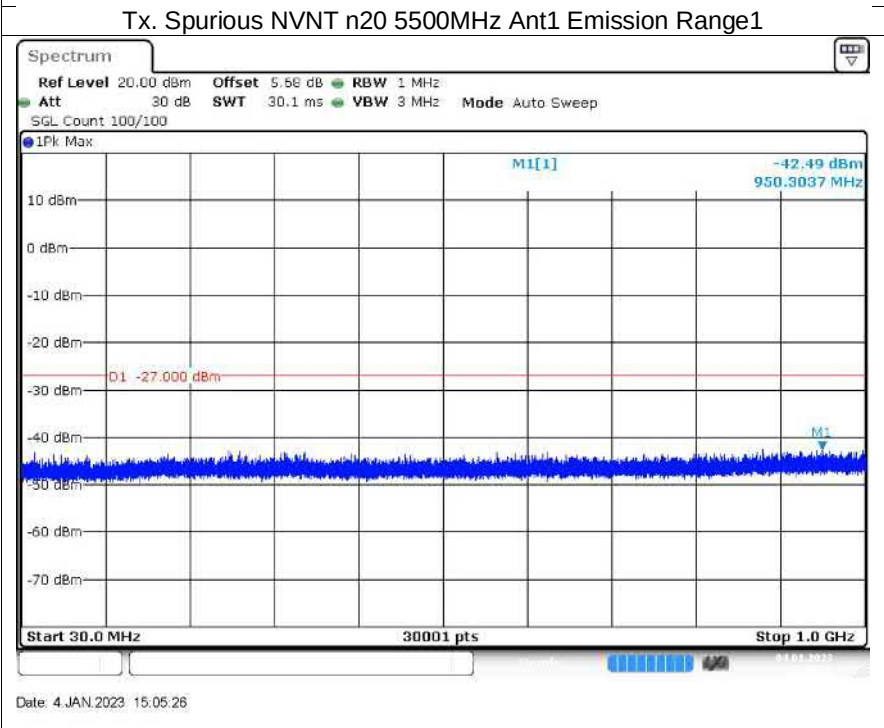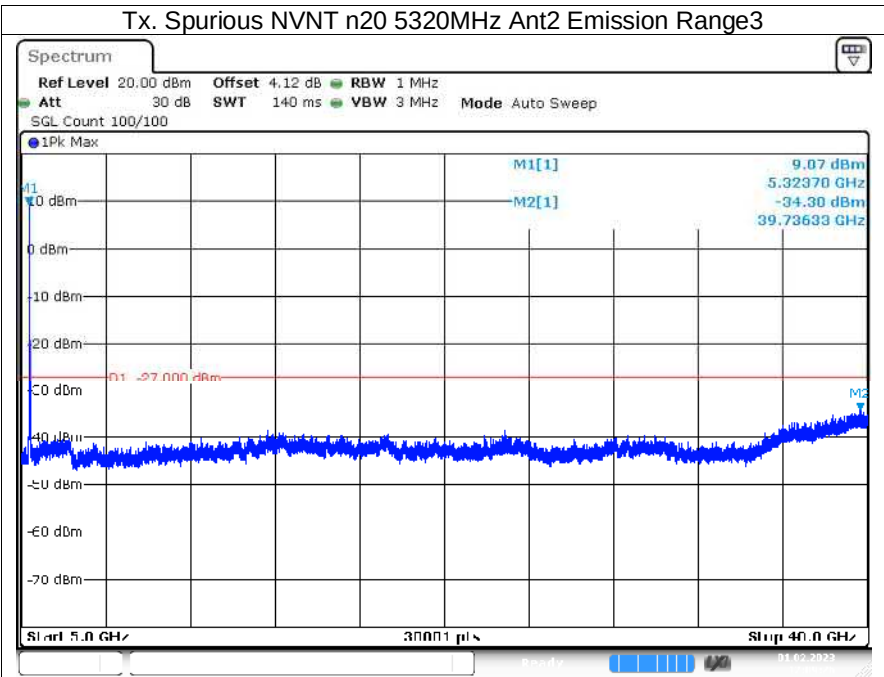


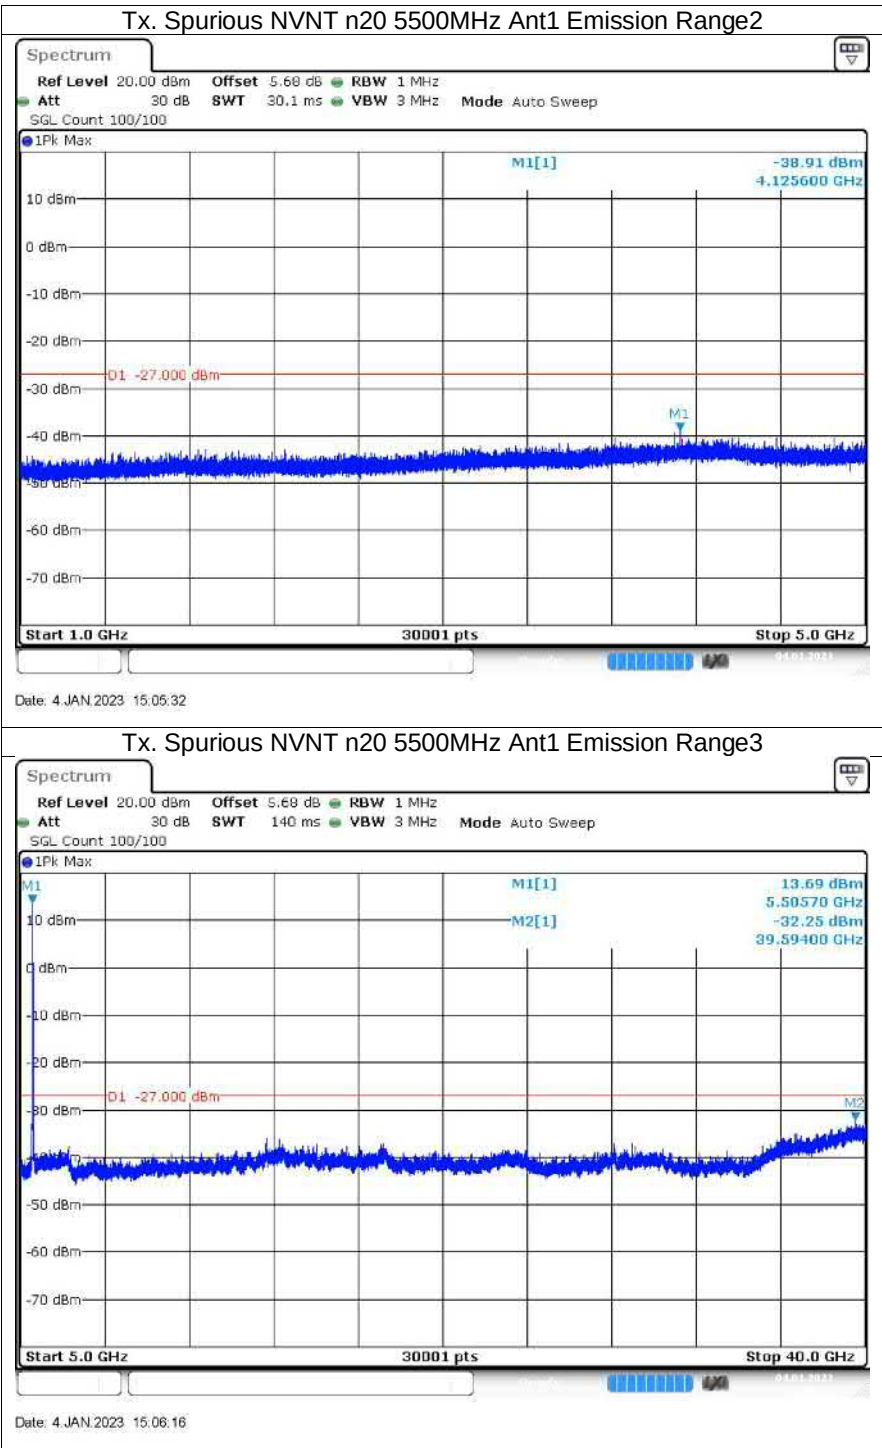


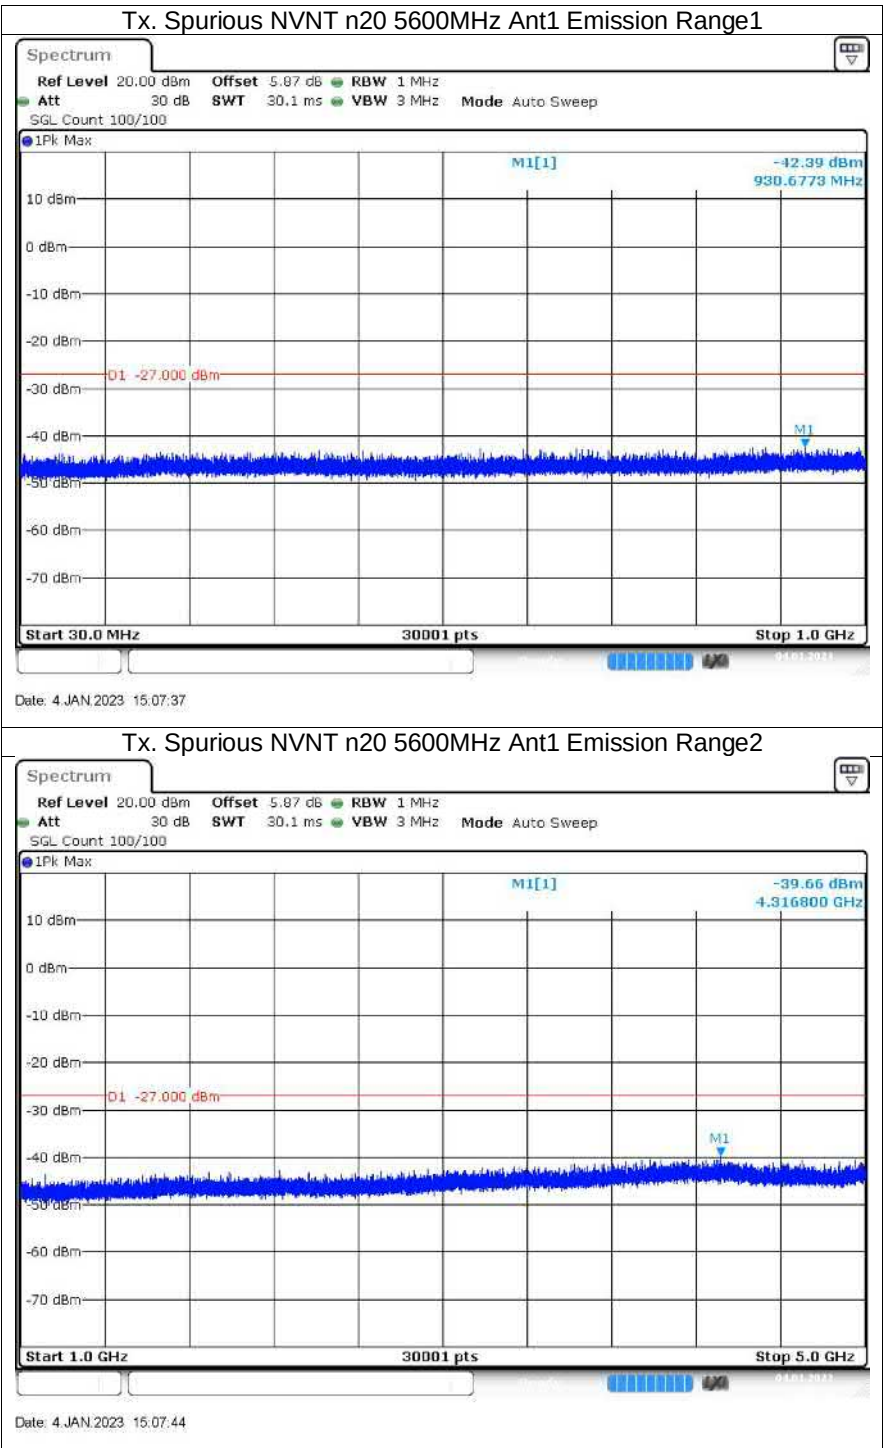


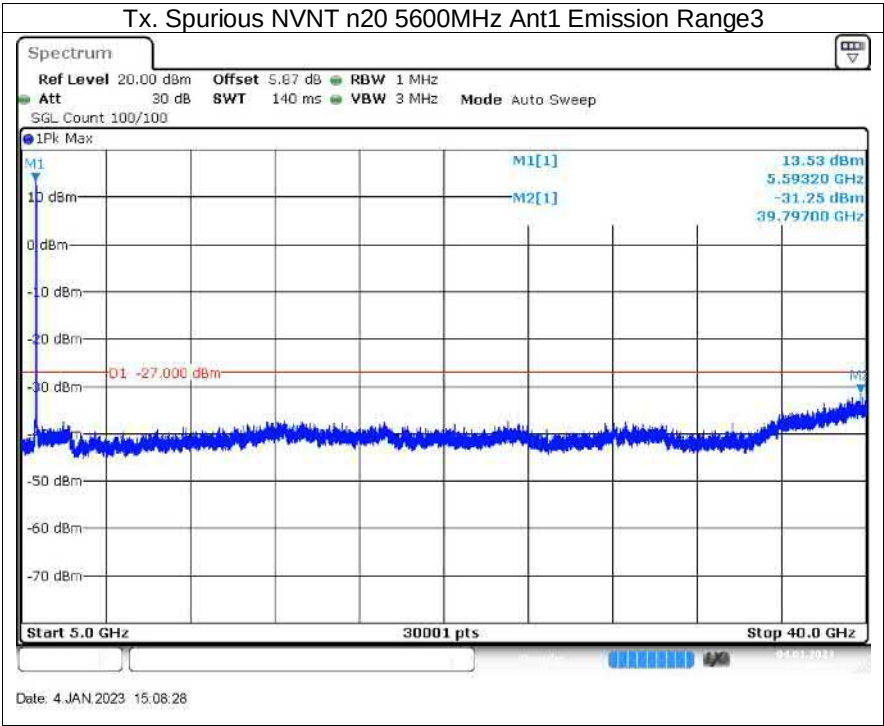


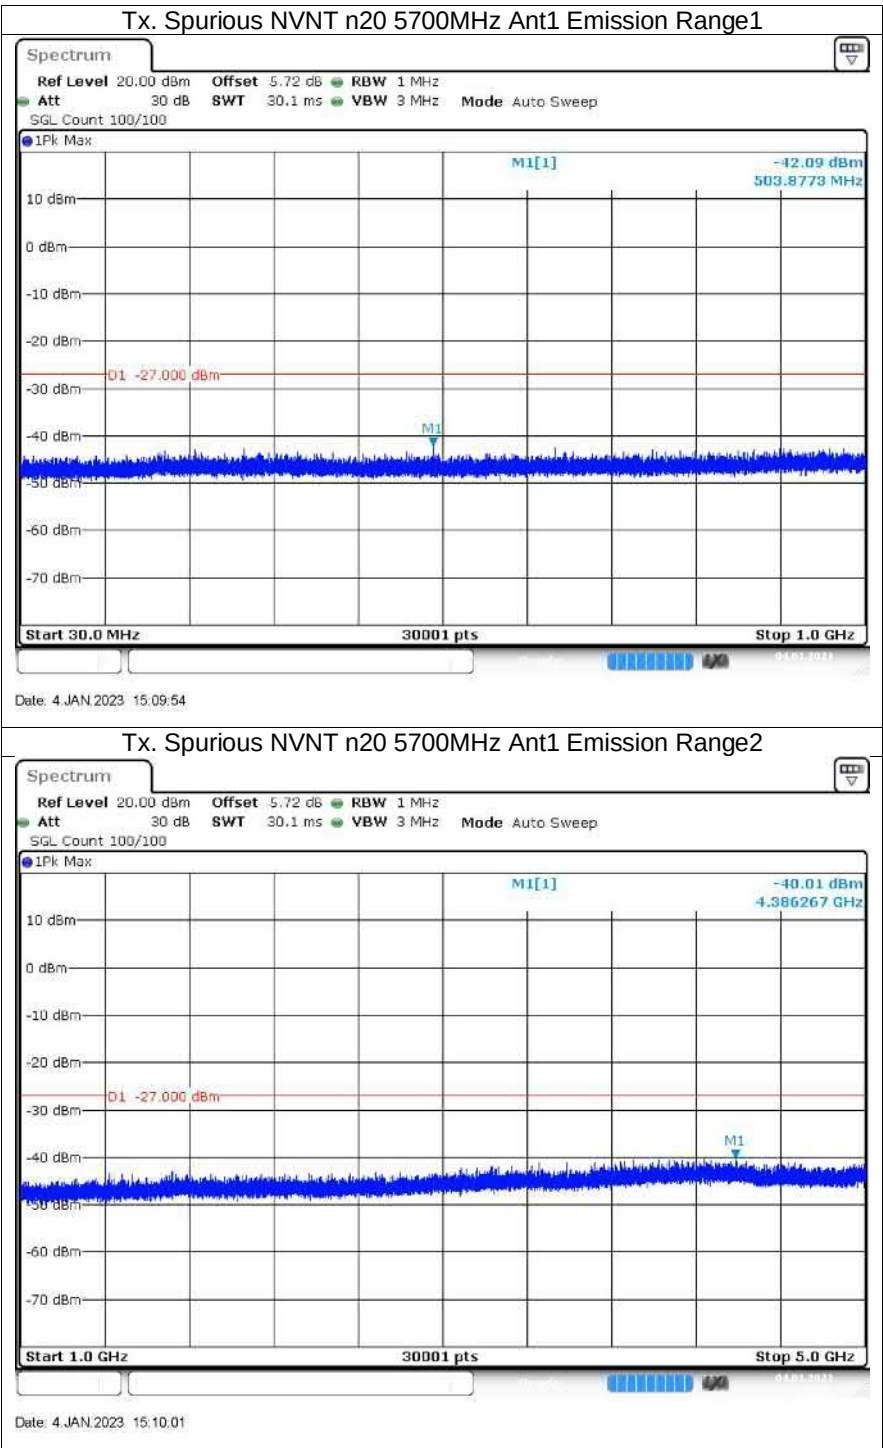

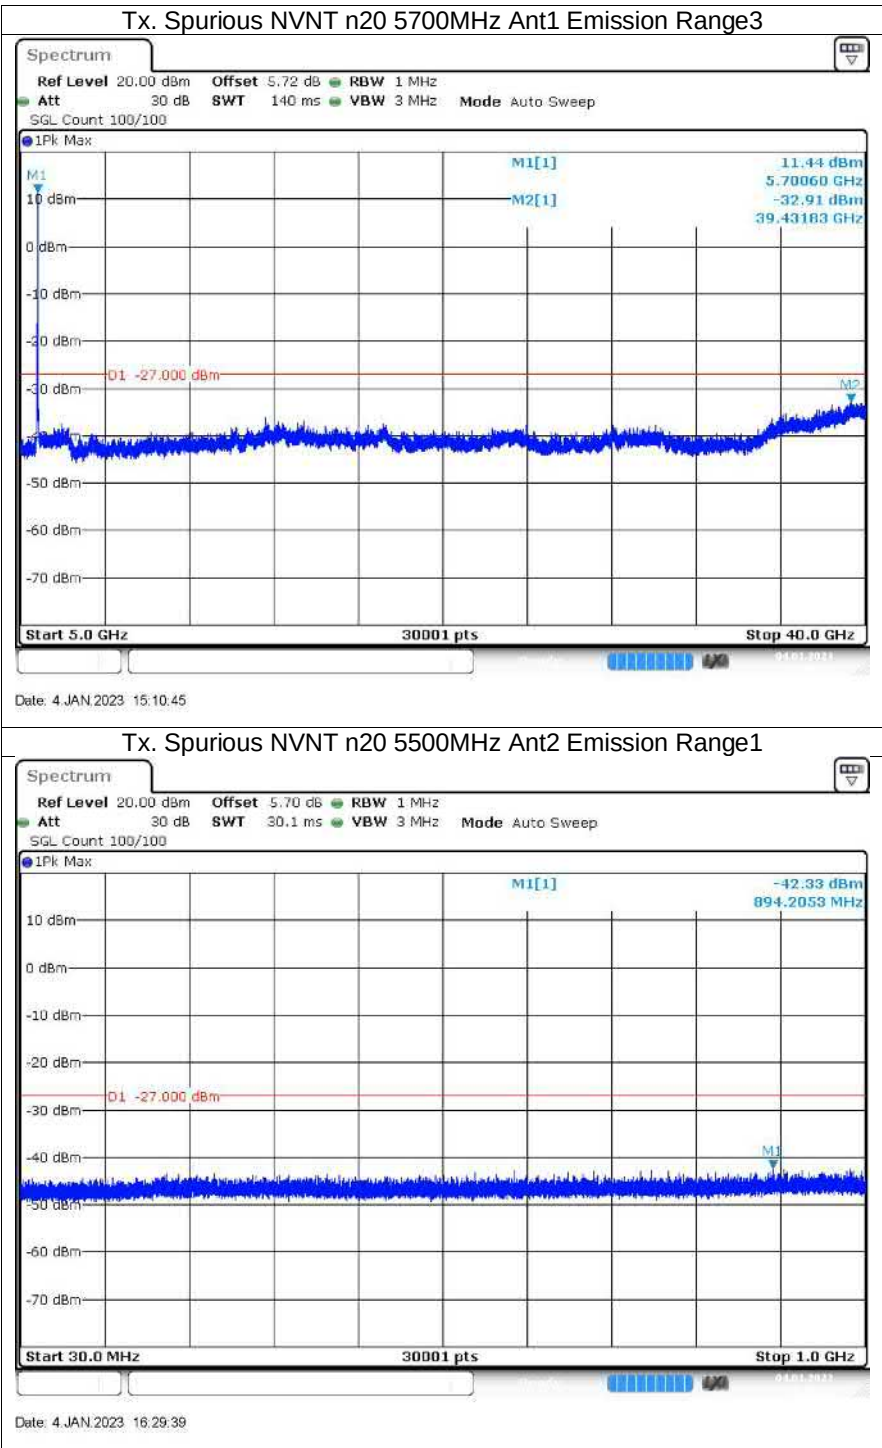

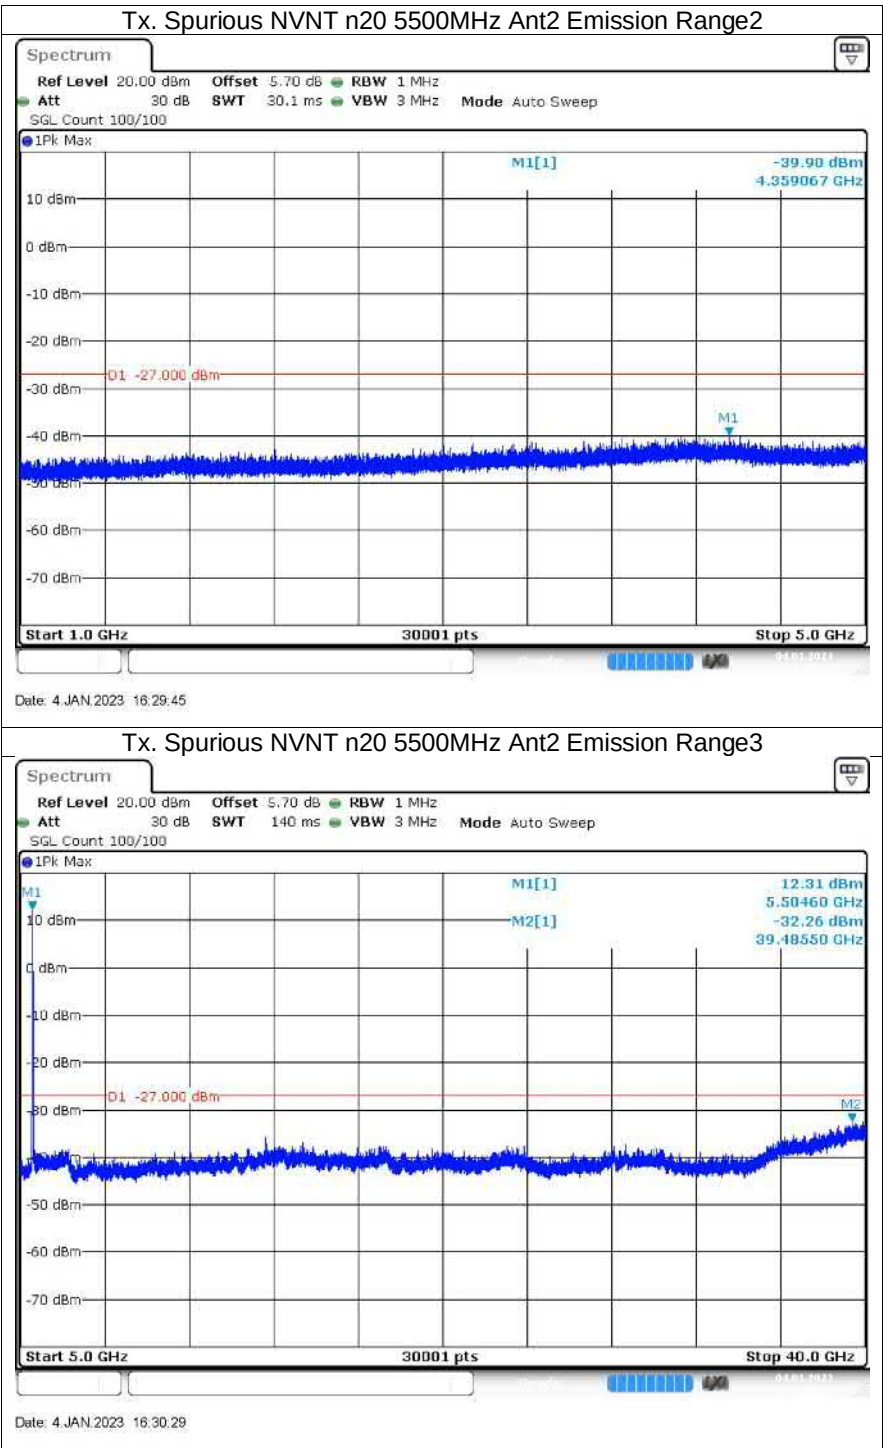

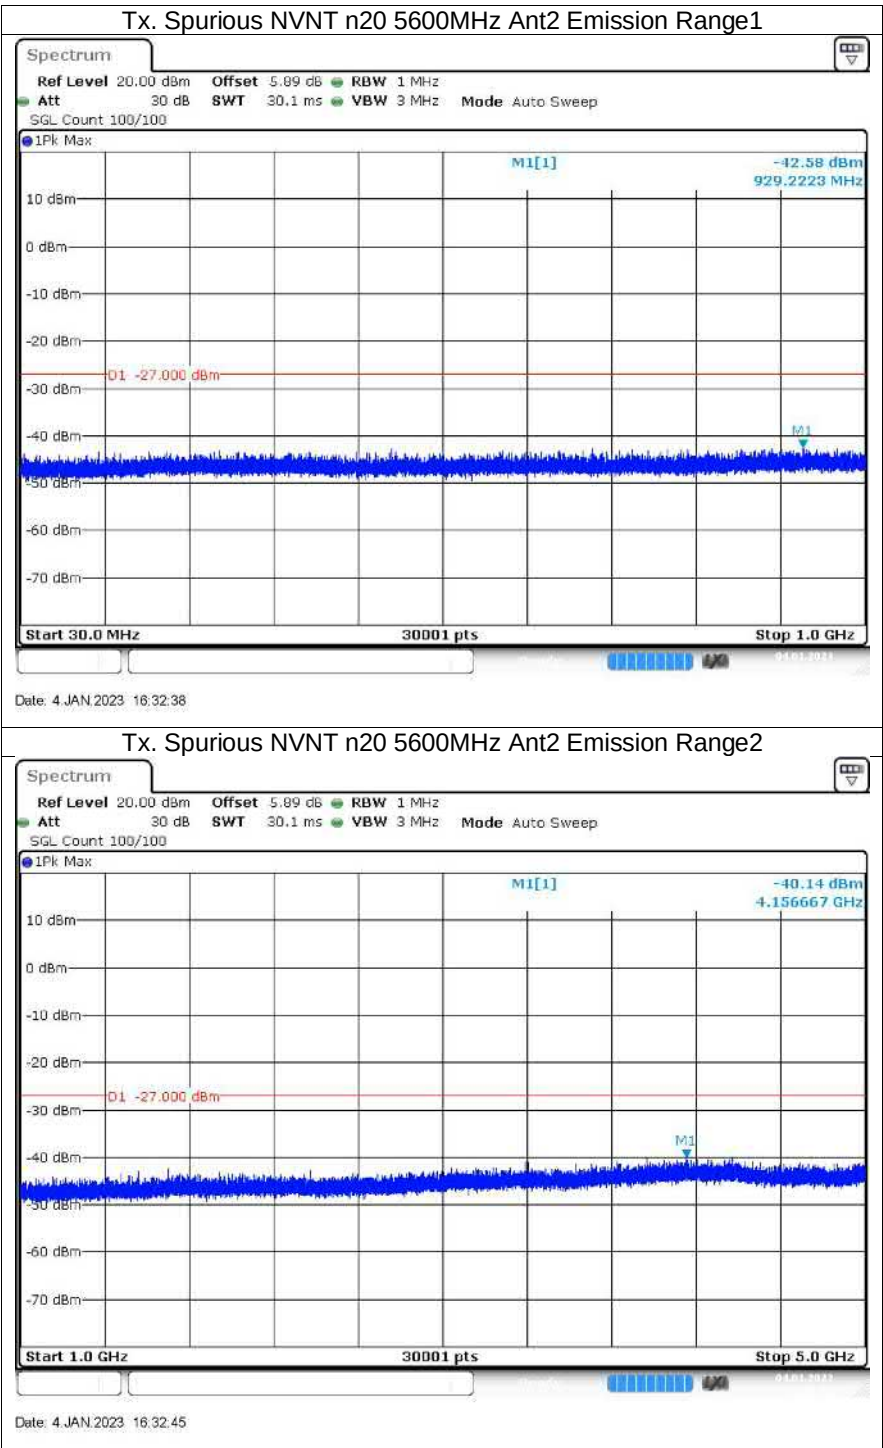

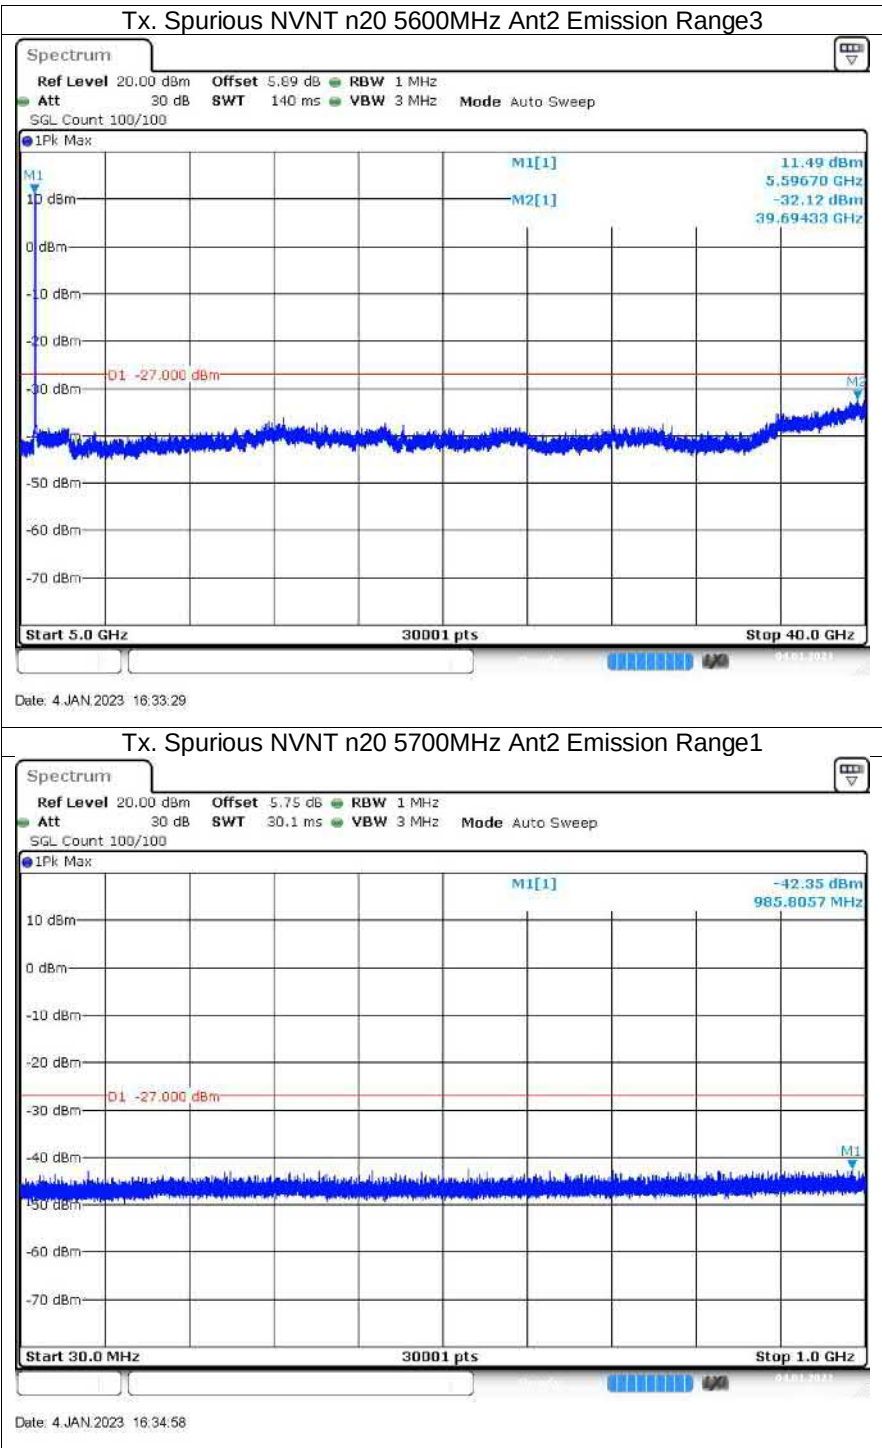



China

