



NVNT	n40	5230	Ant3	36.044
NVNT	n40	5270	Ant3	36.028
NVNT	n40	5310	Ant3	36.204
NVNT	n40	5510	Ant3	36.159
NVNT	n40	5550	Ant3	36.108
NVNT	n40	5670	Ant3	36.226
NVNT	n40	5755	Ant3	36.153
NVNT	n40	5795	Ant3	36.069
NVNT	ac20	5180	Ant1	17.866
NVNT	ac20	5200	Ant1	17.751
NVNT	ac20	5240	Ant1	17.679
NVNT	ac20	5260	Ant1	19.13
NVNT	ac20	5300	Ant1	17.773
NVNT	ac20	5320	Ant1	17.738
NVNT	ac20	5500	Ant1	17.743
NVNT	ac20	5580	Ant1	17.656
NVNT	ac20	5700	Ant1	17.716
NVNT	ac20	5745	Ant1	17.742
NVNT	ac20	5785	Ant1	17.659
NVNT	ac20	5825	Ant1	17.727
NVNT	ac20	5180	Ant2	17.77
NVNT	ac20	5200	Ant2	17.767
NVNT	ac20	5240	Ant2	17.708
NVNT	ac20	5260	Ant2	17.695
NVNT	ac20	5300	Ant2	17.791
NVNT	ac20	5320	Ant2	17.766
NVNT	ac20	5500	Ant2	17.767
NVNT	ac20	5580	Ant2	17.686
NVNT	ac20	5700	Ant2	17.775
NVNT	ac20	5745	Ant2	17.761
NVNT	ac20	5785	Ant2	17.66
NVNT	ac20	5825	Ant2	17.718
NVNT	ac20	5180	Ant3	17.735
NVNT	ac20	5200	Ant3	17.716
NVNT	ac20	5240	Ant3	17.638
NVNT	ac20	5260	Ant3	17.65
NVNT	ac20	5300	Ant3	17.739
NVNT	ac20	5320	Ant3	18.024
NVNT	ac20	5500	Ant3	17.746
NVNT	ac20	5580	Ant3	18.182
NVNT	ac20	5700	Ant3	17.696
NVNT	ac20	5745	Ant3	17.692
NVNT	ac20	5785	Ant3	17.654
NVNT	ac20	5825	Ant3	17.71
NVNT	ac40	5190	Ant1	36.159
NVNT	ac40	5230	Ant1	36.02
NVNT	ac40	5270	Ant1	36.049
NVNT	ac40	5310	Ant1	36.175
NVNT	ac40	5510	Ant1	36.197
NVNT	ac40	5550	Ant1	36.021
NVNT	ac40	5670	Ant1	36.203
NVNT	ac40	5755	Ant1	36.144
NVNT	ac40	5795	Ant1	36.009
NVNT	ac40	5190	Ant2	36.311
NVNT	ac40	5230	Ant2	36.192
NVNT	ac40	5270	Ant2	36.171
NVNT	ac40	5310	Ant2	36.266
NVNT	ac40	5510	Ant2	36.274
NVNT	ac40	5550	Ant2	36.105
NVNT	ac40	5670	Ant2	36.299
NVNT	ac40	5755	Ant2	36.178
NVNT	ac40	5795	Ant2	36.161
NVNT	ac40	5190	Ant3	36.208
NVNT	ac40	5230	Ant3	36.106
NVNT	ac40	5270	Ant3	36.057
NVNT	ac40	5310	Ant3	36.225
NVNT	ac40	5510	Ant3	36.187
NVNT	ac40	5550	Ant3	36.098
NVNT	ac40	5670	Ant3	36.251
NVNT	ac40	5755	Ant3	36.242
NVNT	ac40	5795	Ant3	36.105
NVNT	ac80	5210	Ant1	75.38
NVNT	ac80	5290	Ant1	75.36
NVNT	ac80	5530	Ant1	75.304
NVNT	ac80	5610	Ant1	75.392
NVNT	ac80	5775	Ant1	75.264
NVNT	ac80	5210	Ant2	75.54
NVNT	ac80	5290	Ant2	75.474
NVNT	ac80	5530	Ant2	75.459
NVNT	ac80	5610	Ant2	75.264
NVNT	ac80	5775	Ant2	75.318
NVNT	ac80	5210	Ant3	75.293
NVNT	ac80	5290	Ant3	75.298
NVNT	ac80	5530	Ant3	75.291
NVNT	ac80	5610	Ant3	75.232
NVNT	ac80	5775	Ant3	75.311
NVNT	ac160	5250	Ant1	154.237
NVNT	ac160	5570	Ant1	154.017
NVNT	ac160	5250	Ant2	153.977
NVNT	ac160	5570	Ant2	153.893
NVNT	ac160	5250	Ant3	153.588
NVNT	ac160	5570	Ant3	153.716
NVNT	ax20	5180	Ant1	18.997
NVNT	ax20	5200	Ant1	18.993



NVNT	ax20	5240	Ant1	18.874
NVNT	ax20	5260	Ant1	18.922
NVNT	ax20	5300	Ant1	18.96
NVNT	ax20	5320	Ant1	18.978
NVNT	ax20	5500	Ant1	18.941
NVNT	ax20	5580	Ant1	18.918
NVNT	ax20	5700	Ant1	18.991
NVNT	ax20	5745	Ant1	18.929
NVNT	ax20	5785	Ant1	18.921
NVNT	ax20	5825	Ant1	19.001
NVNT	ax20	5180	Ant2	18.966
NVNT	ax20	5200	Ant2	18.984
NVNT	ax20	5240	Ant2	18.861
NVNT	ax20	5260	Ant2	19.152
NVNT	ax20	5300	Ant2	18.959
NVNT	ax20	5320	Ant2	19.282
NVNT	ax20	5500	Ant2	18.98
NVNT	ax20	5580	Ant2	19.005
NVNT	ax20	5700	Ant2	18.974
NVNT	ax20	5745	Ant2	18.963
NVNT	ax20	5785	Ant2	18.911
NVNT	ax20	5825	Ant2	18.96
NVNT	ax20	5180	Ant3	18.984
NVNT	ax20	5200	Ant3	18.988
NVNT	ax20	5240	Ant3	18.862
NVNT	ax20	5260	Ant3	18.929
NVNT	ax20	5300	Ant3	18.994
NVNT	ax20	5320	Ant3	19.011
NVNT	ax20	5500	Ant3	18.953
NVNT	ax20	5580	Ant3	18.957
NVNT	ax20	5700	Ant3	18.955
NVNT	ax20	5745	Ant3	18.947
NVNT	ax20	5785	Ant3	18.967
NVNT	ax20	5825	Ant3	18.989
NVNT	ax40	5190	Ant1	37.636
NVNT	ax40	5230	Ant1	37.534
NVNT	ax40	5270	Ant1	37.565
NVNT	ax40	5310	Ant1	37.626
NVNT	ax40	5510	Ant1	37.643
NVNT	ax40	5550	Ant1	37.548
NVNT	ax40	5670	Ant1	37.687
NVNT	ax40	5755	Ant1	37.656
NVNT	ax40	5795	Ant1	37.572
NVNT	ax40	5190	Ant2	37.599
NVNT	ax40	5230	Ant2	37.519
NVNT	ax40	5270	Ant2	37.53
NVNT	ax40	5310	Ant2	37.686
NVNT	ax40	5510	Ant2	37.784
NVNT	ax40	5550	Ant2	37.572
NVNT	ax40	5670	Ant2	37.649
NVNT	ax40	5755	Ant2	37.65
NVNT	ax40	5795	Ant2	37.495
NVNT	ax40	5190	Ant3	37.639
NVNT	ax40	5230	Ant3	37.551
NVNT	ax40	5270	Ant3	37.551
NVNT	ax40	5310	Ant3	37.608
NVNT	ax40	5510	Ant3	37.597
NVNT	ax40	5550	Ant3	37.629
NVNT	ax40	5670	Ant3	37.71
NVNT	ax40	5755	Ant3	37.642
NVNT	ax40	5795	Ant3	37.644
NVNT	ax80	5210	Ant1	76.936
NVNT	ax80	5290	Ant1	76.93
NVNT	ax80	5530	Ant1	76.884
NVNT	ax80	5610	Ant1	76.974
NVNT	ax80	5775	Ant1	76.728
NVNT	ax80	5210	Ant2	77.033
NVNT	ax80	5290	Ant2	77.033
NVNT	ax80	5530	Ant2	76.818
NVNT	ax80	5610	Ant2	76.897
NVNT	ax80	5775	Ant2	76.894
NVNT	ax80	5210	Ant3	76.922
NVNT	ax80	5290	Ant3	77.052
NVNT	ax80	5530	Ant3	76.906
NVNT	ax80	5610	Ant3	76.877
NVNT	ax80	5775	Ant3	76.953
NVNT	ax160	5250	Ant1	155.275
NVNT	ax160	5570	Ant1	155.398
NVNT	ax160	5250	Ant2	155.225
NVNT	ax160	5570	Ant2	155.307
NVNT	ax160	5250	Ant3	154.96
NVNT	ax160	5570	Ant3	155.424














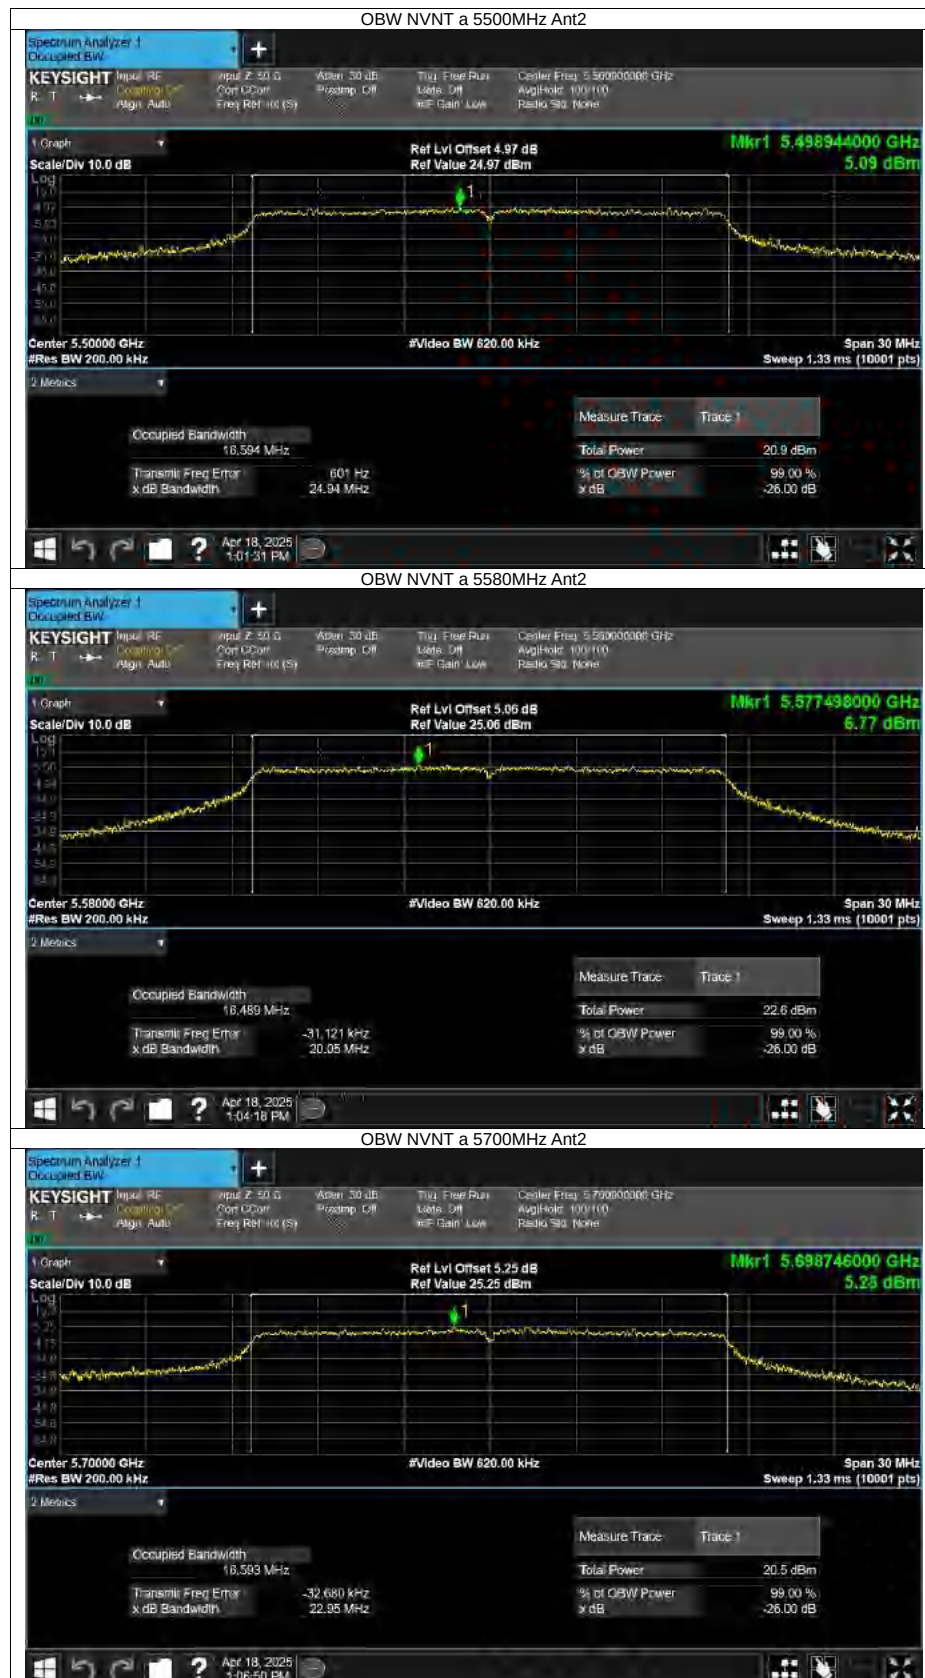














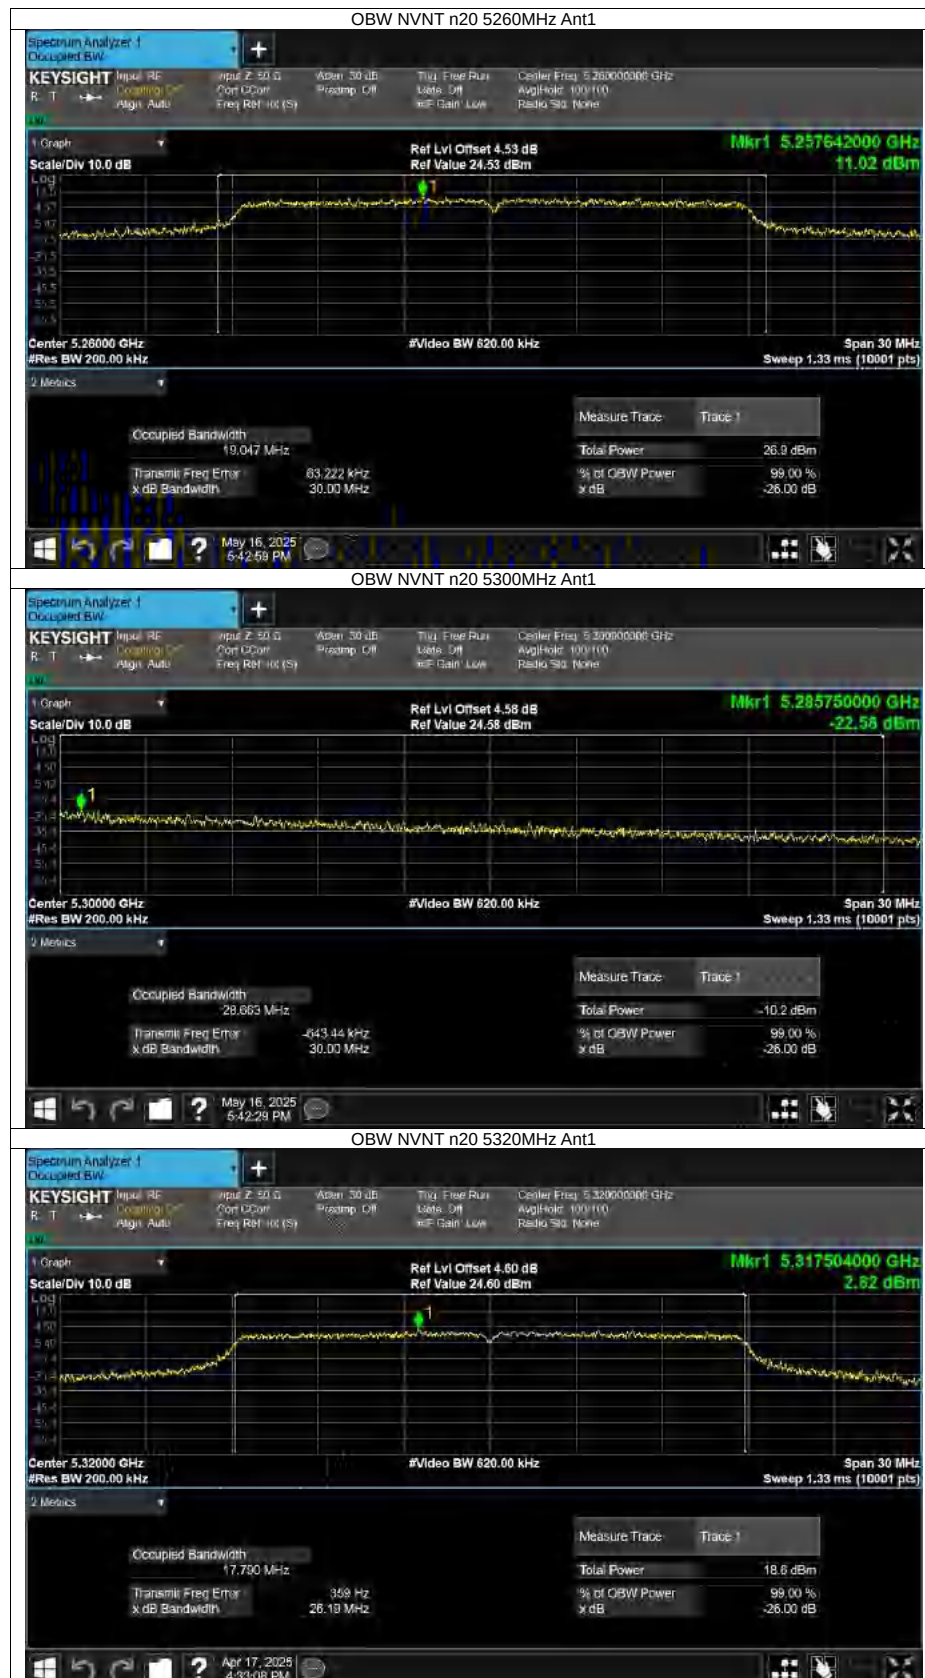





















































































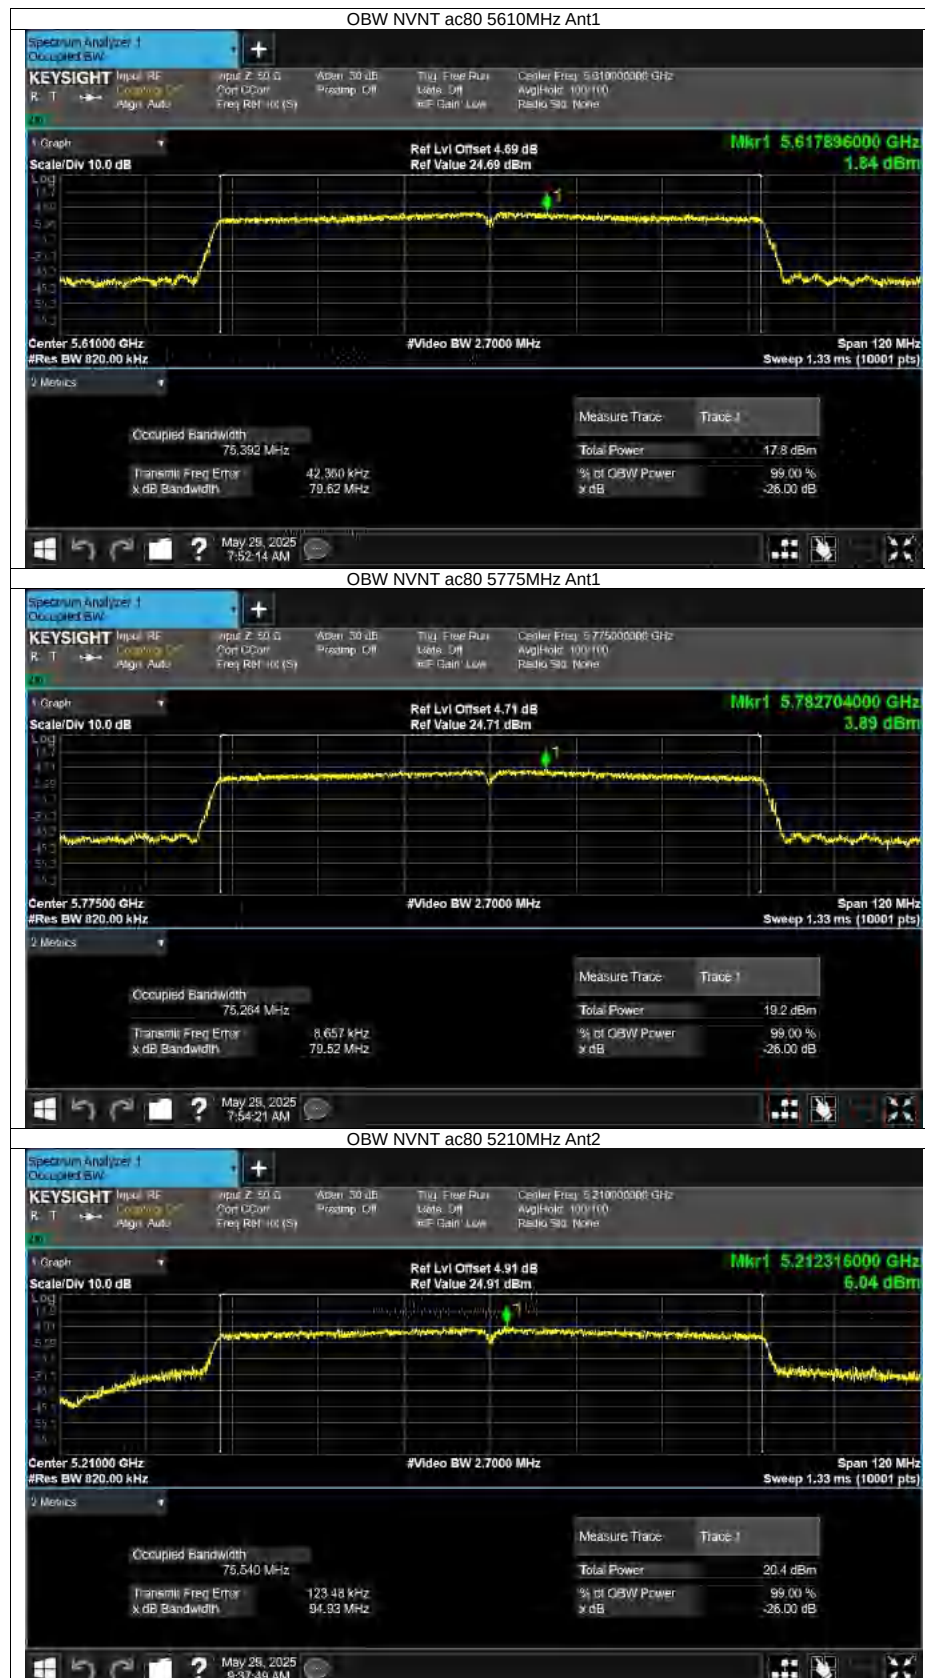





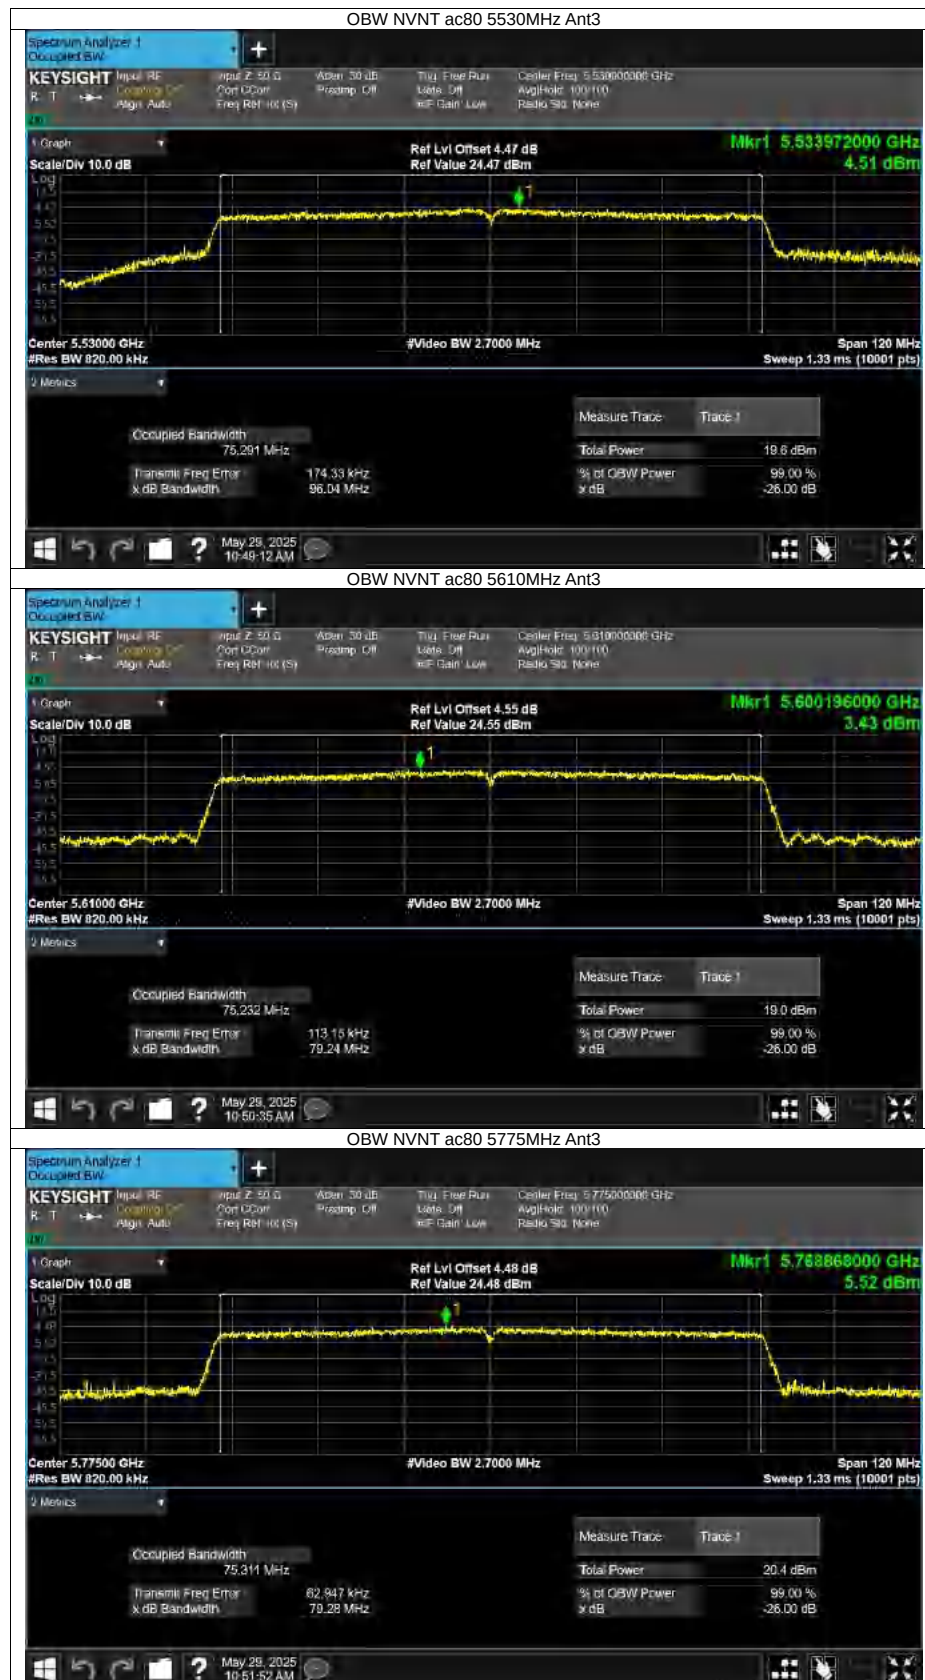
































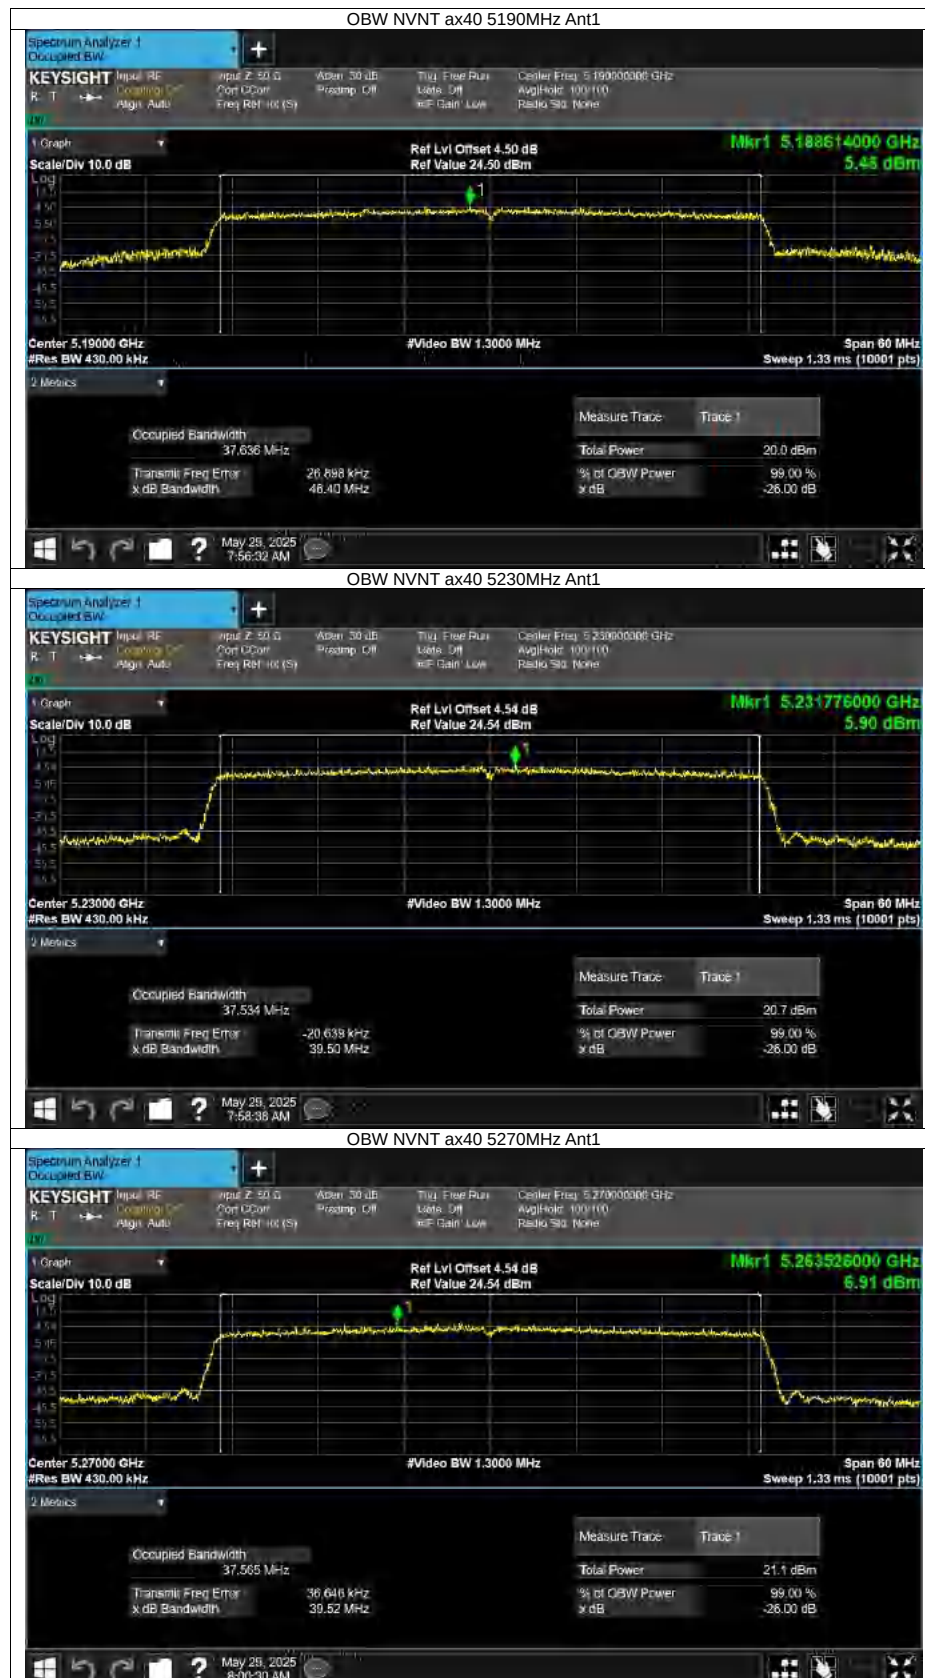

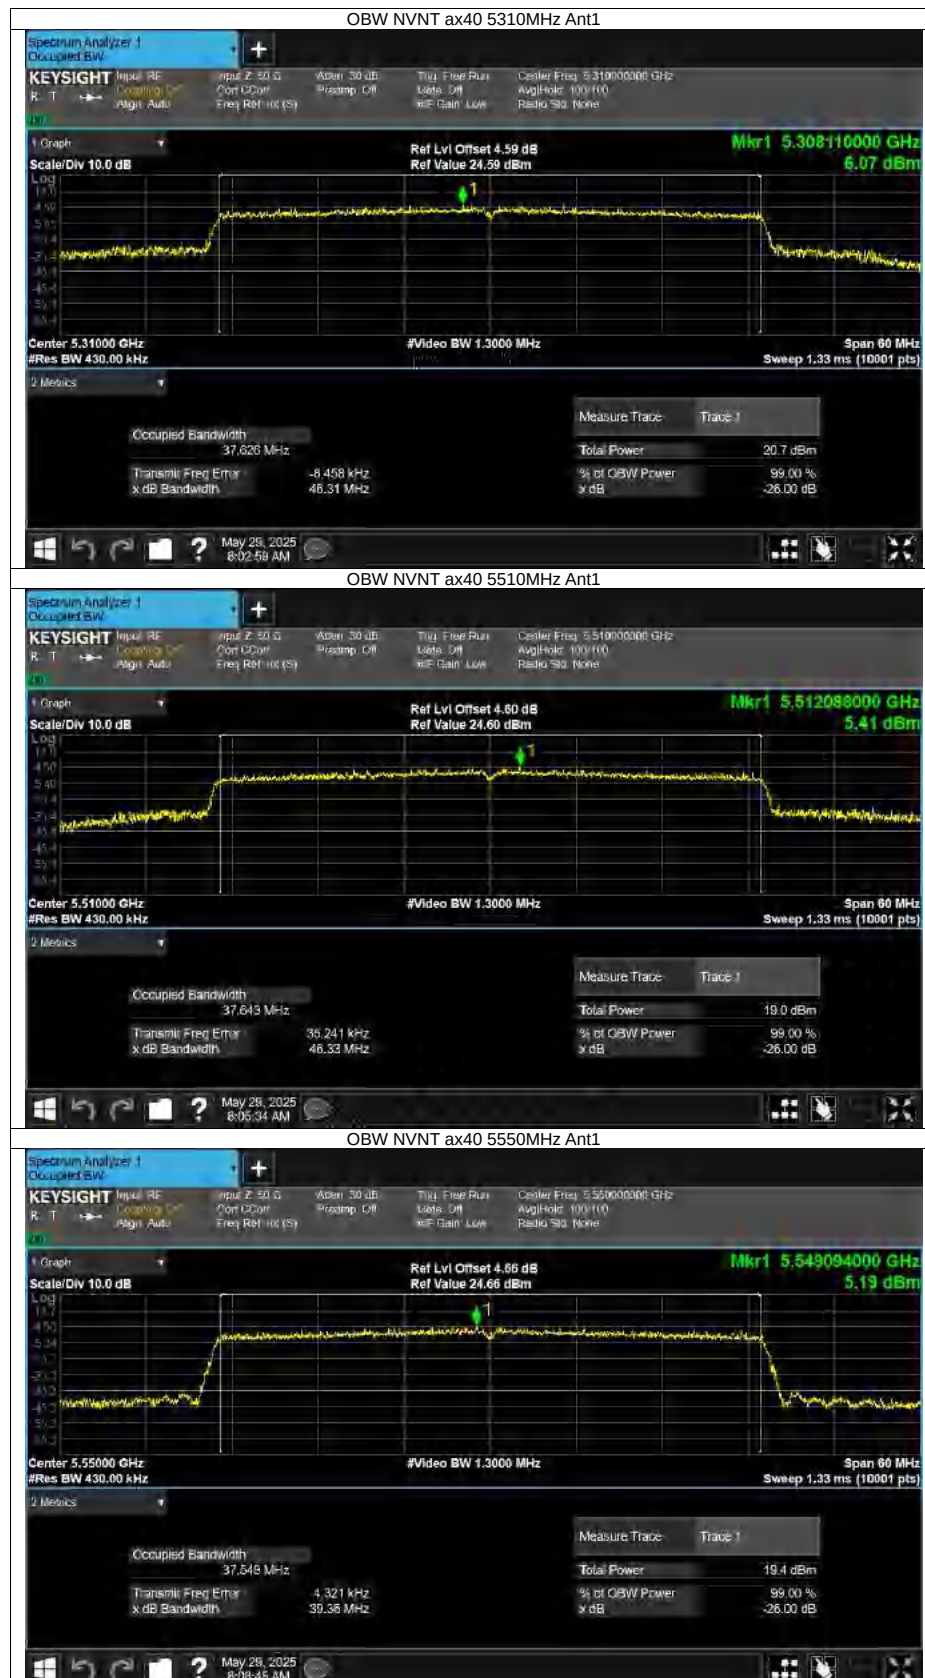




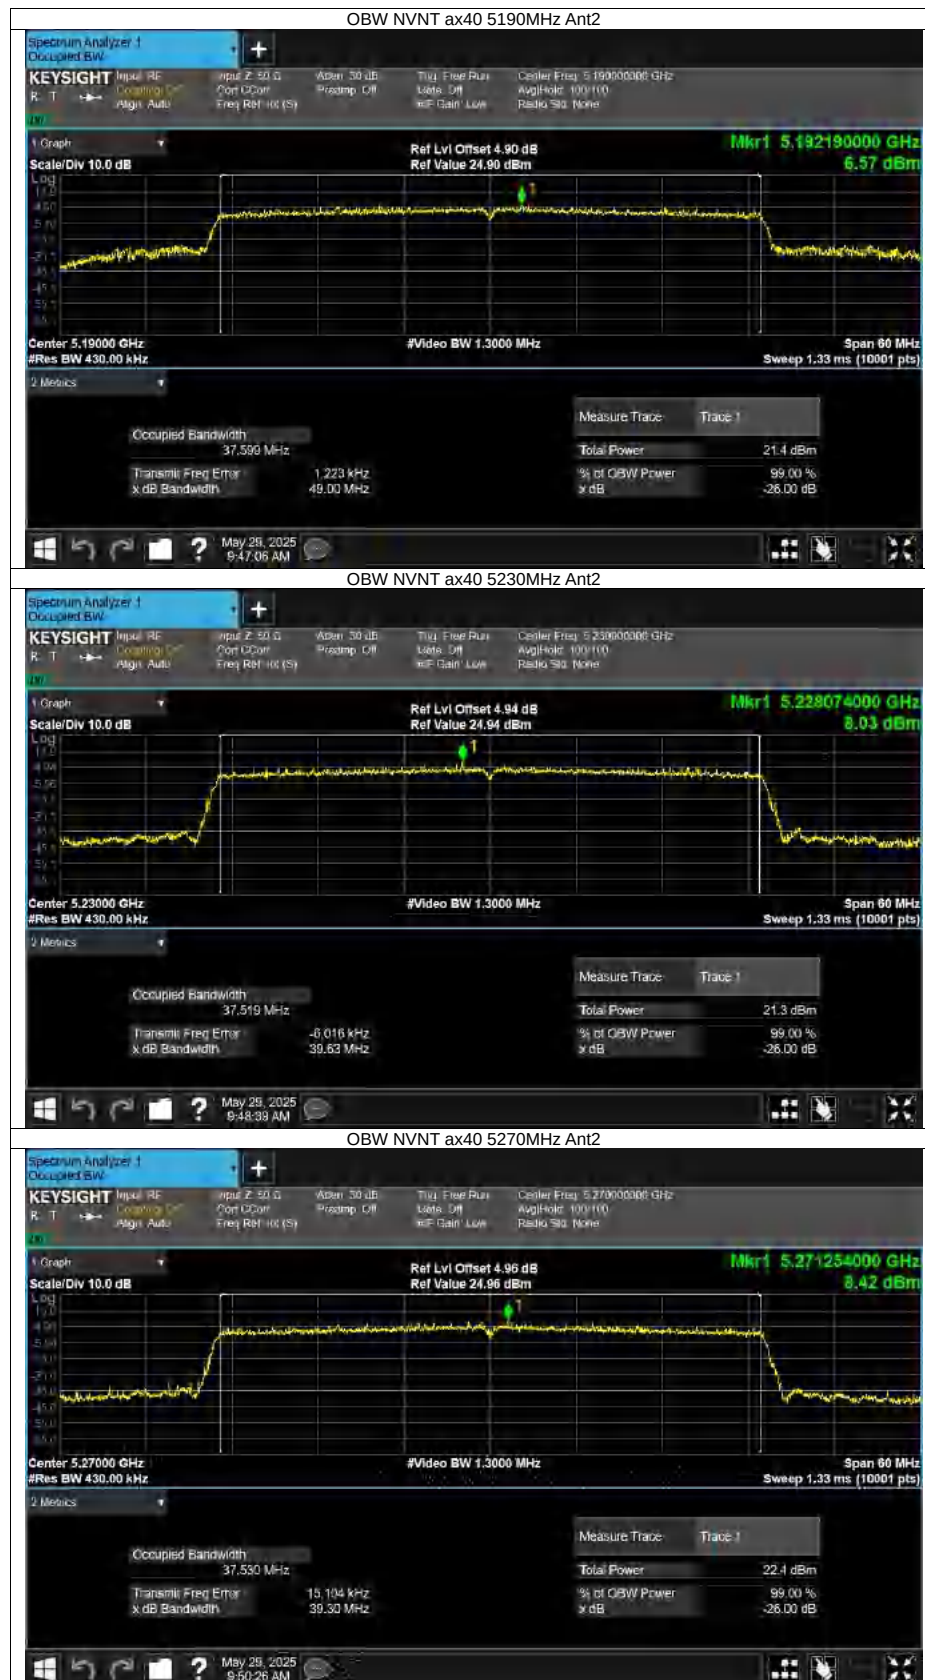






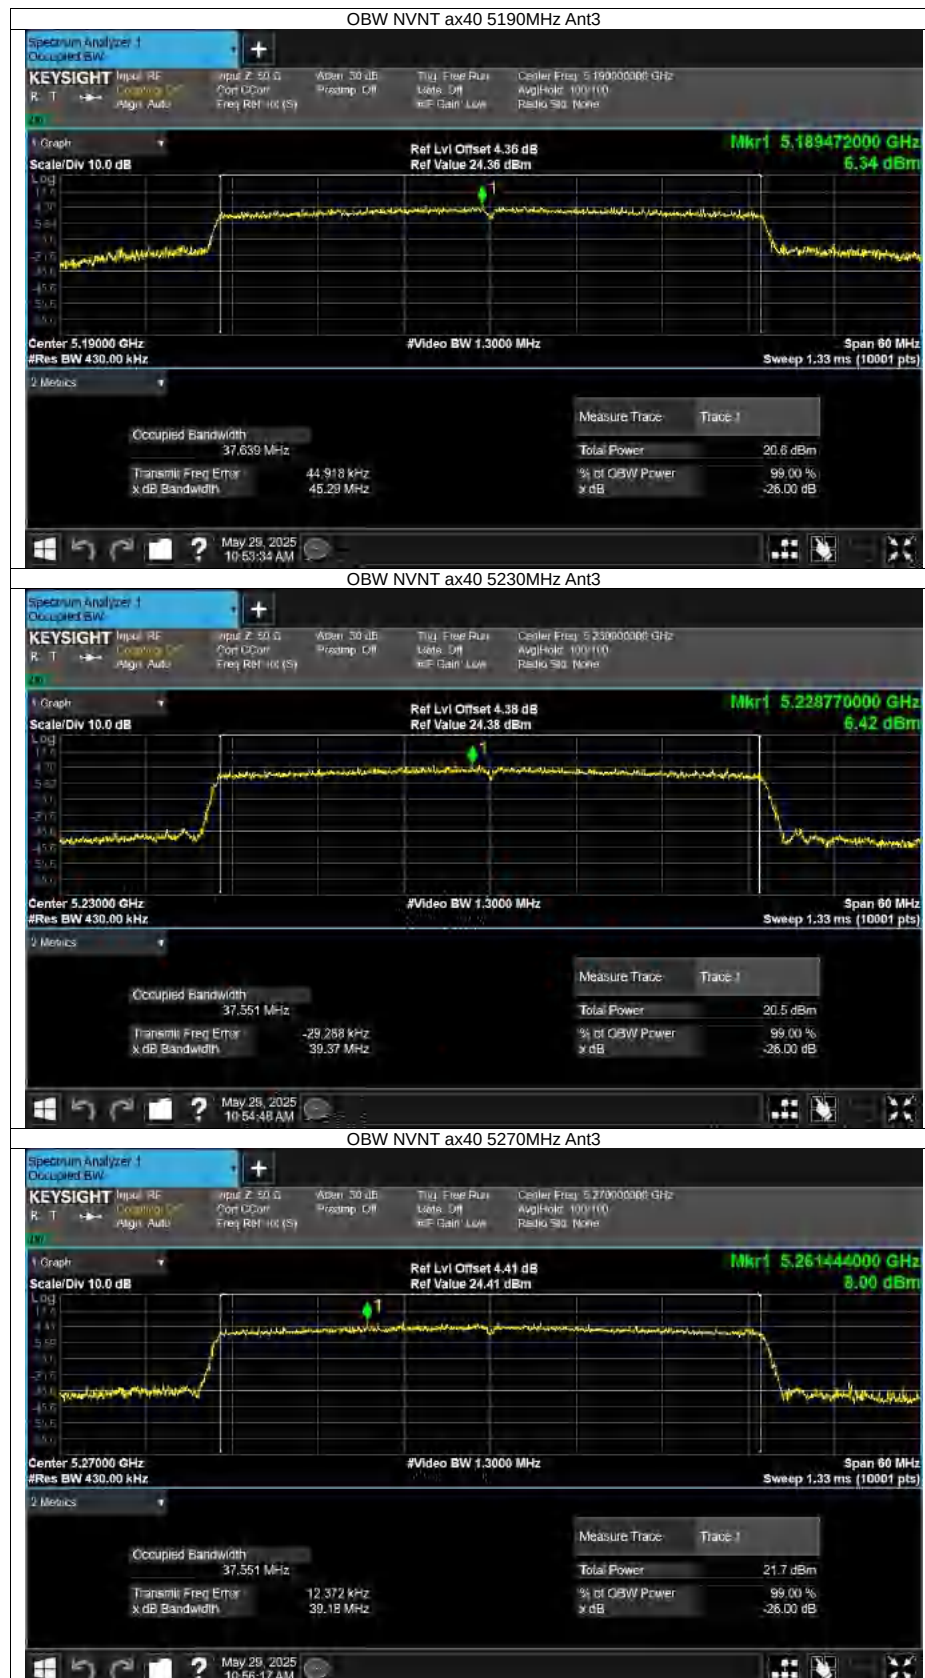








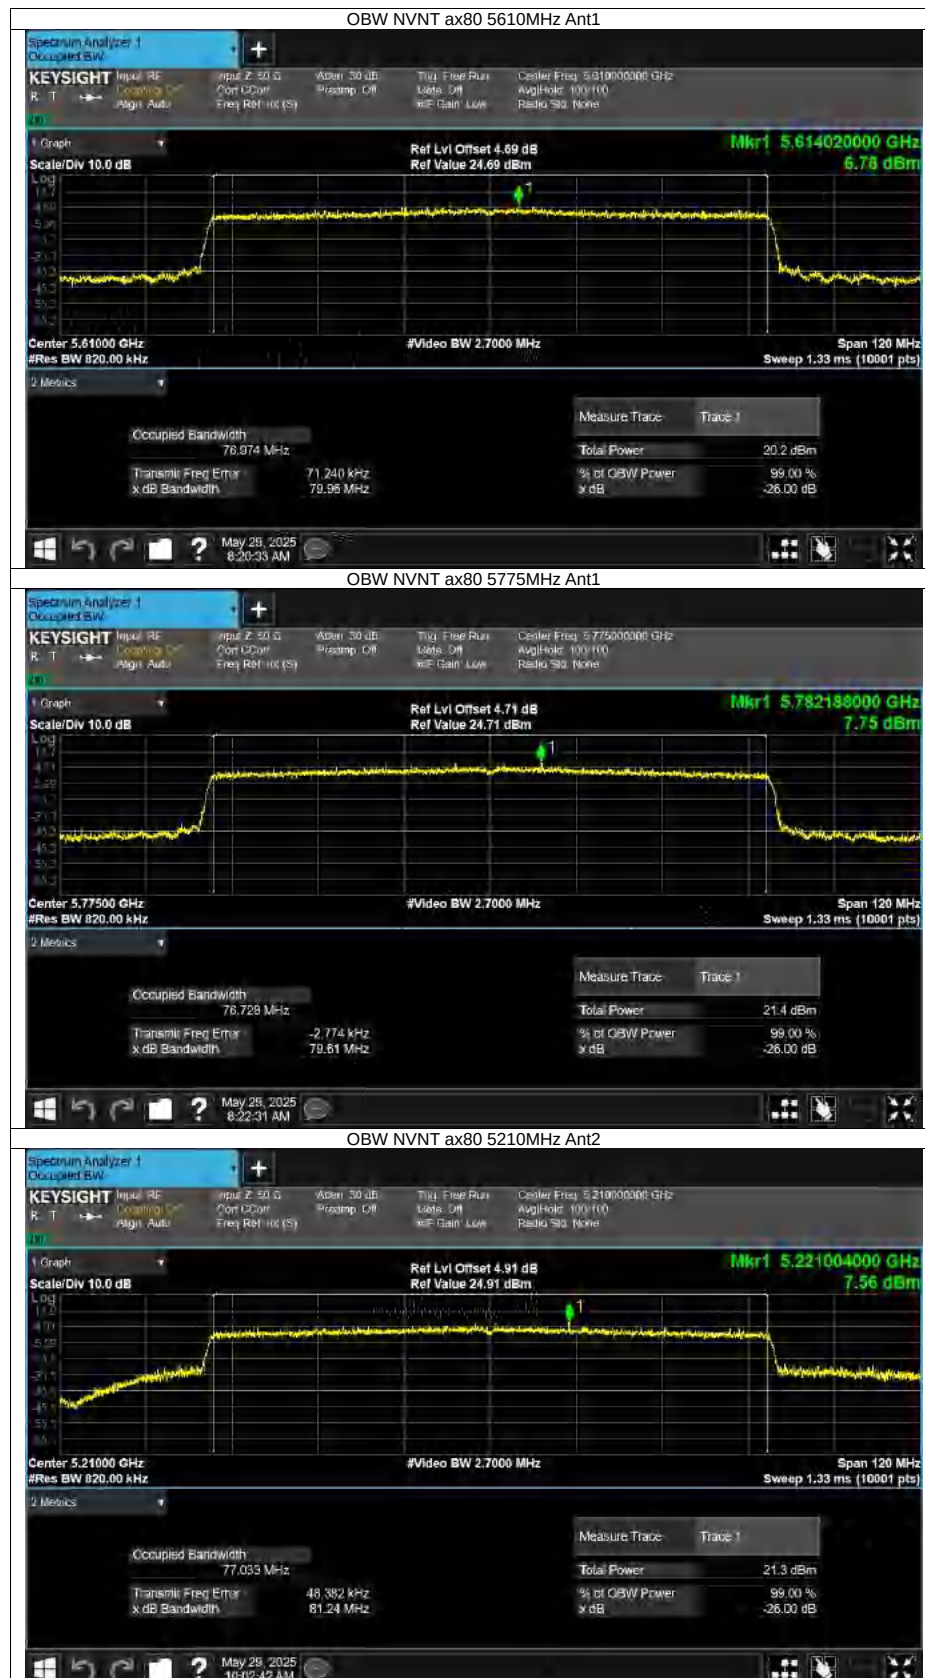





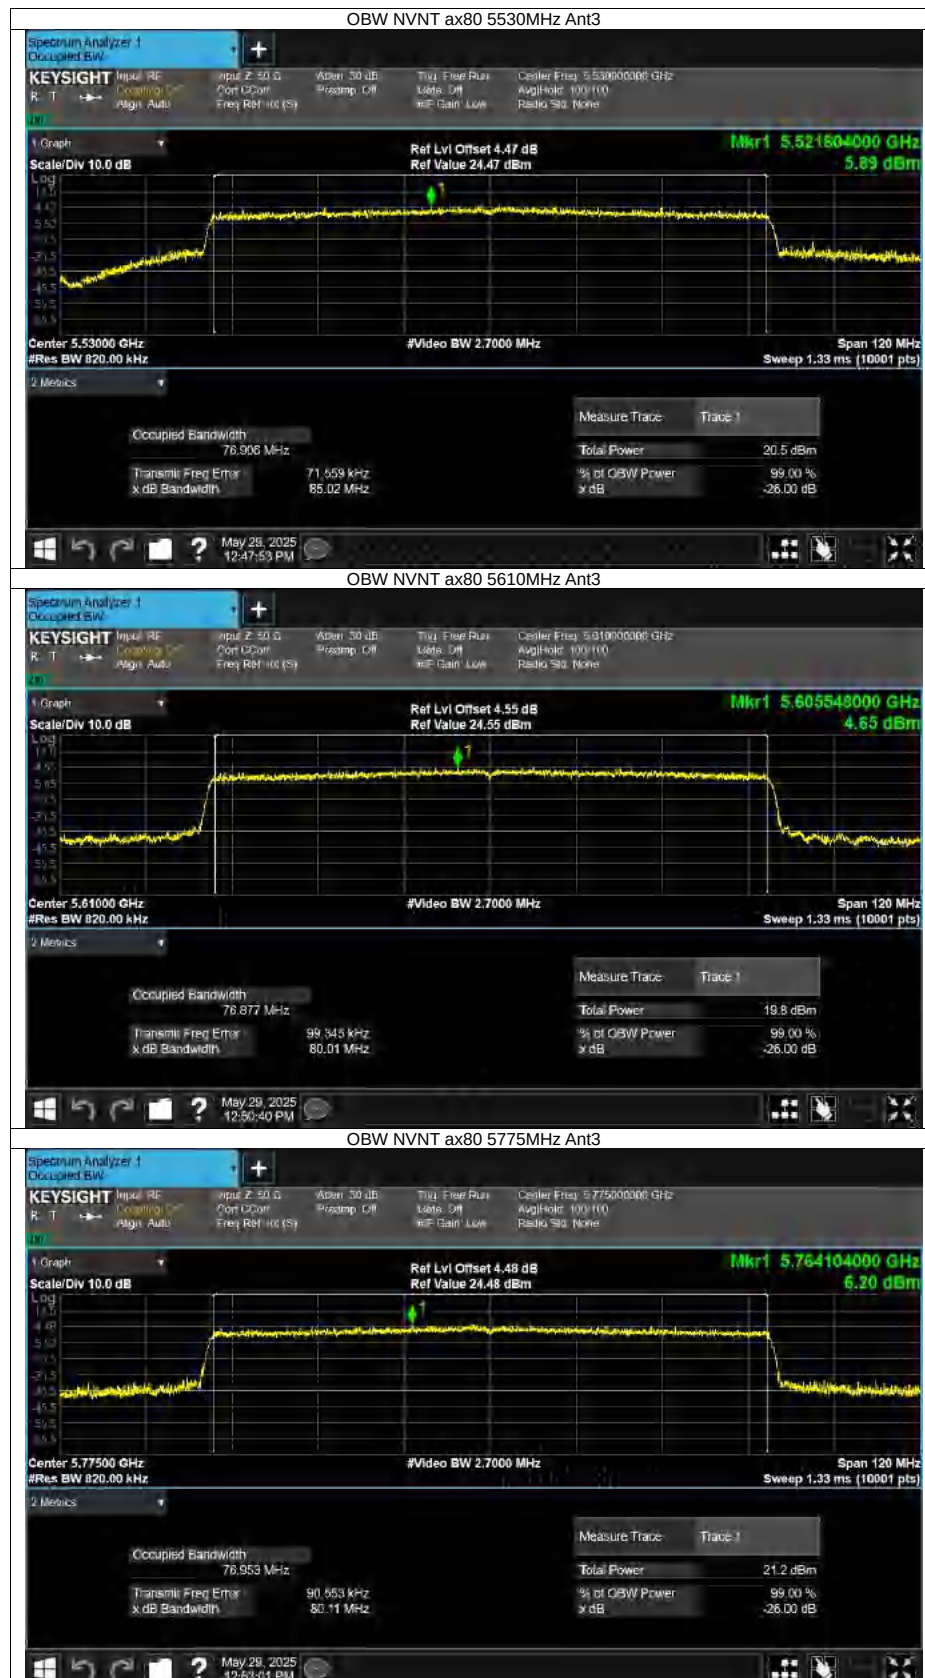







Band Edge

Condition	Mode	Frequency (MHz)	Antenna	Max Value (dBc)	Limit (dBc)	Verdict
NVNT	a	5180	Ant1	-36.72	-27	Pass
NVNT	a	5240	Ant1	-38.13	-27	Pass
NVNT	a	5260	Ant1	-35.96	-27	Pass
NVNT	a	5320	Ant1	-37.1	-27	Pass
NVNT	a	5500	Ant1	-37.22	-27	Pass
NVNT	a	5700	Ant1	-37.87	-27	Pass
NVNT	a	5180	Ant2	-34.59	-27	Pass
NVNT	a	5240	Ant2	-38.55	-27	Pass
NVNT	a	5260	Ant2	-35.52	-27	Pass
NVNT	a	5320	Ant2	-36.7	-27	Pass
NVNT	a	5500	Ant2	-37.74	-27	Pass
NVNT	a	5700	Ant2	-36.08	-27	Pass
NVNT	a	5180	Ant3	-35.83	-27	Pass
NVNT	a	5240	Ant3	-39.65	-27	Pass
NVNT	a	5260	Ant3	-36.31	-27	Pass
NVNT	a	5320	Ant3	-37.93	-27	Pass
NVNT	a	5500	Ant3	-37.37	-27	Pass
NVNT	a	5700	Ant3	-35.98	-27	Pass
NVNT	n20	5180	Ant1	-36.21	-27	Pass
NVNT	n20	5240	Ant1	-38.99	-27	Pass
NVNT	n20	5260	Ant1	-37.5	-27	Pass
NVNT	n20	5320	Ant1	-37.21	-27	Pass
NVNT	n20	5500	Ant1	-37.93	-27	Pass
NVNT	n20	5700	Ant1	-37.72	-27	Pass
NVNT	n20	5180	Ant2	-35.13	-27	Pass
NVNT	n20	5240	Ant2	-38.31	-27	Pass
NVNT	n20	5260	Ant2	-35.85	-27	Pass
NVNT	n20	5320	Ant2	-36.25	-27	Pass
NVNT	n20	5500	Ant2	-37.69	-27	Pass
NVNT	n20	5700	Ant2	-35.73	-27	Pass
NVNT	n20	5180	Ant3	-36.43	-27	Pass
NVNT	n20	5240	Ant3	-39.8	-27	Pass
NVNT	n20	5260	Ant3	-35.56	-27	Pass
NVNT	n20	5320	Ant3	-38.27	-27	Pass
NVNT	n20	5500	Ant3	-38.4	-27	Pass
NVNT	n20	5700	Ant3	-37.51	-27	Pass
NVNT	n40	5190	Ant1	-35.9	-27	Pass
NVNT	n40	5230	Ant1	-38.77	-27	Pass
NVNT	n40	5270	Ant1	-36.78	-27	Pass
NVNT	n40	5310	Ant1	-37.4	-27	Pass
NVNT	n40	5510	Ant1	-37.05	-27	Pass
NVNT	n40	5670	Ant1	-37.46	-27	Pass
NVNT	n40	5190	Ant2	-35.56	-27	Pass
NVNT	n40	5230	Ant2	-39.1	-27	Pass
NVNT	n40	5270	Ant2	-36.9	-27	Pass
NVNT	n40	5310	Ant2	-37.16	-27	Pass
NVNT	n40	5510	Ant2	-37.78	-27	Pass
NVNT	n40	5670	Ant2	-36.98	-27	Pass
NVNT	n40	5190	Ant3	-36.51	-27	Pass
NVNT	n40	5230	Ant3	-39.66	-27	Pass
NVNT	n40	5270	Ant3	-36.52	-27	Pass
NVNT	n40	5310	Ant3	-37.4	-27	Pass
NVNT	n40	5510	Ant3	-36.99	-27	Pass
NVNT	n40	5670	Ant3	-37.58	-27	Pass
NVNT	ac20	5180	Ant1	-37.6	-27	Pass
NVNT	ac20	5240	Ant1	-38.64	-27	Pass
NVNT	ac20	5260	Ant1	-36.73	-27	Pass
NVNT	ac20	5320	Ant1	-37.84	-27	Pass
NVNT	ac20	5500	Ant1	-38.62	-27	Pass
NVNT	ac20	5700	Ant1	-37.63	-27	Pass
NVNT	ac20	5180	Ant2	-35.12	-27	Pass
NVNT	ac20	5240	Ant2	-38.21	-27	Pass
NVNT	ac20	5260	Ant2	-36.16	-27	Pass
NVNT	ac20	5320	Ant2	-36.36	-27	Pass
NVNT	ac20	5500	Ant2	-36.44	-27	Pass
NVNT	ac20	5700	Ant2	-36.43	-27	Pass
NVNT	ac20	5180	Ant3	-36.26	-27	Pass
NVNT	ac20	5240	Ant3	-39.06	-27	Pass
NVNT	ac20	5260	Ant3	-37.06	-27	Pass
NVNT	ac20	5320	Ant3	-37.74	-27	Pass
NVNT	ac20	5500	Ant3	-37.4	-27	Pass
NVNT	ac20	5700	Ant3	-37.12	-27	Pass
NVNT	ac40	5190	Ant1	-35.38	-27	Pass
NVNT	ac40	5230	Ant1	-38.68	-27	Pass
NVNT	ac40	5270	Ant1	-36.41	-27	Pass
NVNT	ac40	5310	Ant1	-37.63	-27	Pass
NVNT	ac40	5510	Ant1	-37.68	-27	Pass
NVNT	ac40	5670	Ant1	-38.13	-27	Pass
NVNT	ac40	5190	Ant2	-34.91	-27	Pass
NVNT	ac40	5230	Ant2	-38.62	-27	Pass
NVNT	ac40	5270	Ant2	-35.59	-27	Pass
NVNT	ac40	5310	Ant2	-36.66	-27	Pass
NVNT	ac40	5510	Ant2	-36.24	-27	Pass
NVNT	ac40	5670	Ant2	-37.38	-27	Pass
NVNT	ac40	5190	Ant3	-36.82	-27	Pass
NVNT	ac40	5230	Ant3	-38.85	-27	Pass
NVNT	ac40	5270	Ant3	-36.38	-27	Pass
NVNT	ac40	5310	Ant3	-37.51	-27	Pass
NVNT	ac40	5510	Ant3	-36.89	-27	Pass
NVNT	ac40	5670	Ant3	-37.44	-27	Pass
NVNT	ac80	5210	Ant1	-32.34	-27	Pass



NVNT	ac80	5290	Ant1	-33.39	-27	Pass
NVNT	ac80	5530	Ant1	-33.12	-27	Pass
NVNT	ac80	5610	Ant1	-38.46	-27	Pass
NVNT	ac80	5210	Ant2	-32.44	-27	Pass
NVNT	ac80	5290	Ant2	-32.06	-27	Pass
NVNT	ac80	5530	Ant2	-34.17	-27	Pass
NVNT	ac80	5610	Ant2	-37.26	-27	Pass
NVNT	ac80	5210	Ant3	-33.92	-27	Pass
NVNT	ac80	5290	Ant3	-32.06	-27	Pass
NVNT	ac80	5530	Ant3	-34.05	-27	Pass
NVNT	ac80	5610	Ant3	-38.12	-27	Pass
NVNT	ac160	5250	Ant1	-35.45	-27	Pass
NVNT	ac160	5570	Ant1	-38.3	-27	Pass
NVNT	ac160	5250	Ant2	-34.35	-27	Pass
NVNT	ac160	5570	Ant2	-37.78	-27	Pass
NVNT	ac160	5250	Ant3	-33.12	-27	Pass
NVNT	ac160	5570	Ant3	-32.29	-27	Pass
NVNT	ax20	5180	Ant1	-36.27	-27	Pass
NVNT	ax20	5240	Ant1	-39.34	-27	Pass
NVNT	ax20	5260	Ant1	-35.39	-27	Pass
NVNT	ax20	5320	Ant1	-37.68	-27	Pass
NVNT	ax20	5500	Ant1	-37.53	-27	Pass
NVNT	ax20	5700	Ant1	-36.91	-27	Pass
NVNT	ax20	5180	Ant2	-34.75	-27	Pass
NVNT	ax20	5240	Ant2	-38.44	-27	Pass
NVNT	ax20	5260	Ant2	-35.21	-27	Pass
NVNT	ax20	5320	Ant2	-36.32	-27	Pass
NVNT	ax20	5500	Ant2	-37.21	-27	Pass
NVNT	ax20	5700	Ant2	-36.32	-27	Pass
NVNT	ax20	5180	Ant3	-36	-27	Pass
NVNT	ax20	5240	Ant3	-39.37	-27	Pass
NVNT	ax20	5260	Ant3	-35.77	-27	Pass
NVNT	ax20	5320	Ant3	-38.7	-27	Pass
NVNT	ax20	5500	Ant3	-38.08	-27	Pass
NVNT	ax20	5700	Ant3	-35.34	-27	Pass
NVNT	ax40	5190	Ant1	-35.98	-27	Pass
NVNT	ax40	5230	Ant1	-38.63	-27	Pass
NVNT	ax40	5270	Ant1	-36.77	-27	Pass
NVNT	ax40	5310	Ant1	-37.67	-27	Pass
NVNT	ax40	5510	Ant1	-36.27	-27	Pass
NVNT	ax40	5670	Ant1	-37.06	-27	Pass
NVNT	ax40	5190	Ant2	-35.04	-27	Pass
NVNT	ax40	5230	Ant2	-38.23	-27	Pass
NVNT	ax40	5270	Ant2	-35.2	-27	Pass
NVNT	ax40	5310	Ant2	-35.4	-27	Pass
NVNT	ax40	5510	Ant2	-36.7	-27	Pass
NVNT	ax40	5670	Ant2	-36.84	-27	Pass
NVNT	ax40	5190	Ant3	-35.99	-27	Pass
NVNT	ax40	5230	Ant3	-38.5	-27	Pass
NVNT	ax40	5270	Ant3	-36.54	-27	Pass
NVNT	ax40	5310	Ant3	-37.91	-27	Pass
NVNT	ax40	5510	Ant3	-37.93	-27	Pass
NVNT	ax40	5670	Ant3	-37.14	-27	Pass
NVNT	ax80	5210	Ant1	-31.38	-27	Pass
NVNT	ax80	5290	Ant1	-32.64	-27	Pass
NVNT	ax80	5530	Ant1	-33.8	-27	Pass
NVNT	ax80	5610	Ant1	-38.23	-27	Pass
NVNT	ax80	5210	Ant2	-30.22	-27	Pass
NVNT	ax80	5290	Ant2	-32.92	-27	Pass
NVNT	ax80	5530	Ant2	-33.47	-27	Pass
NVNT	ax80	5610	Ant2	-37.39	-27	Pass
NVNT	ax80	5210	Ant3	-32.66	-27	Pass
NVNT	ax80	5290	Ant3	-31.69	-27	Pass
NVNT	ax80	5530	Ant3	-33.44	-27	Pass
NVNT	ax80	5610	Ant3	-36.34	-27	Pass
NVNT	ax160	5250	Ant1	-35.14	-27	Pass
NVNT	ax160	5570	Ant1	-36.58	-27	Pass
NVNT	ax160	5250	Ant2	-34.86	-27	Pass
NVNT	ax160	5570	Ant2	-37.62	-27	Pass
NVNT	ax160	5250	Ant3	-34.87	-27	Pass
NVNT	ax160	5570	Ant3	-33.21	-27	Pass
Condition	Mode	Frequency (MHz)	Antenna	Max Value (dBm)	Limit (dBm)	Verdict
NVNT	a	5745	Ant1	-34.97	15.6	Pass
NVNT	a	5825	Ant1	-36.15	15.6	Pass
NVNT	a	5745	Ant2	-32.89	15.6	Pass
NVNT	a	5825	Ant2	-35.91	15.6	Pass
NVNT	a	5745	Ant3	-33.43	15.6	Pass
NVNT	a	5825	Ant3	-35.16	15.6	Pass
NVNT	n20	5745	Ant1	-35.57	15.6	Pass
NVNT	n20	5825	Ant1	-36.54	15.6	Pass
NVNT	n20	5745	Ant2	-35.24	15.6	Pass
NVNT	n20	5825	Ant2	-35.77	15.6	Pass
NVNT	n20	5745	Ant3	-35	15.6	Pass
NVNT	n20	5825	Ant3	-36.61	15.6	Pass
NVNT	n40	5755	Ant1	-32.51	15.6	Pass
NVNT	n40	5795	Ant1	-36.21	15.6	Pass
NVNT	n40	5755	Ant2	-31.53	15.6	Pass
NVNT	n40	5795	Ant2	-35.01	15.6	Pass
NVNT	n40	5755	Ant3	-32.62	15.6	Pass
NVNT	n40	5795	Ant3	-35.1	15.6	Pass
NVNT	ac20	5745	Ant1	-35.83	15.6	Pass
NVNT	ac20	5825	Ant1	-36.58	15.6	Pass
NVNT	ac20	5745	Ant2	-34.59	15.6	Pass
NVNT	ac20	5825	Ant2	-36.05	15.6	Pass



NVNT	ac20	5745	Ant3	-34.1	15.6	Pass
NVNT	ac20	5825	Ant3	-37.02	15.6	Pass
NVNT	ac40	5755	Ant1	-31.53	15.6	Pass
NVNT	ac40	5795	Ant1	-36.27	15.6	Pass
NVNT	ac40	5755	Ant2	-31.95	15.6	Pass
NVNT	ac40	5795	Ant2	-33.16	15.6	Pass
NVNT	ac40	5755	Ant3	-30.13	15.6	Pass
NVNT	ac40	5795	Ant3	-33.03	15.6	Pass
NVNT	ac80	5775	Ant1	-31.93	15.6	Pass
NVNT	ac80	5775	Ant2	-28.26	15.6	Pass
NVNT	ac80	5775	Ant3	-24.93	15.6	Pass
NVNT	ax20	5745	Ant1	-33.57	15.6	Pass
NVNT	ax20	5825	Ant1	-36.86	15.6	Pass
NVNT	ax20	5745	Ant2	-33.03	15.6	Pass
NVNT	ax20	5825	Ant2	-36.15	15.6	Pass
NVNT	ax20	5745	Ant3	-33.04	15.6	Pass
NVNT	ax20	5825	Ant3	-33.99	15.6	Pass
NVNT	ax40	5755	Ant1	-31.61	15.6	Pass
NVNT	ax40	5795	Ant1	-34.61	15.6	Pass
NVNT	ax40	5755	Ant2	-32.95	15.6	Pass
NVNT	ax40	5795	Ant2	-31.53	15.6	Pass
NVNT	ax40	5755	Ant3	-27.21	15.6	Pass
NVNT	ax40	5795	Ant3	-32.68	15.6	Pass
NVNT	ax80	5775	Ant1	-30.06	15.6	Pass
NVNT	ax80	5775	Ant2	-26.34	15.6	Pass
NVNT	ax80	5775	Ant3	-22.03	15.6	Pass

Note: The antenna gain and cable loss have been offset in the test Value.



