

## Appendix Test Data

|                  |                     |                    |             |
|------------------|---------------------|--------------------|-------------|
| Report No.:      | 1813C50477812504-01 | Test Sample No.:   | 1-2-2       |
| Start Test Date: | 2025-11-11          | Finish Test Date:  | 2025-11-17  |
| Test Engineer:   | Alex Peng           | Auditor:           | Justin Feng |
| Temperature:     | 24.7°C              | Relative Humidity: | 50%         |
| Pressure:        | 101kPa              |                    |             |




## Appendix A1: 26dB Bandwidth

### Test Result

| Test Mode  | Antenna | Frequency[MHz] | 26db<br>EBW<br>[MHz] | FL[MHz]  | FH[MHz]  | Limit[MHz] | Verdict |
|------------|---------|----------------|----------------------|----------|----------|------------|---------|
| 11A        | Ant1    | 5180           | 19.960               | 5169.960 | 5189.920 | ---        | ---     |
| 11A        | Ant1    | 5220           | 19.920               | 5210.080 | 5230.000 | ---        | ---     |
| 11A        | Ant1    | 5240           | 19.680               | 5230.240 | 5249.920 | ---        | ---     |
| 11N20SISO  | Ant1    | 5180           | 20.320               | 5169.760 | 5190.080 | ---        | ---     |
| 11N20SISO  | Ant1    | 5220           | 20.280               | 5209.920 | 5230.200 | ---        | ---     |
| 11N20SISO  | Ant1    | 5240           | 20.240               | 5229.880 | 5250.120 | ---        | ---     |
| 11N40SISO  | Ant1    | 5190           | 41.040               | 5169.360 | 5210.400 | ---        | ---     |
| 11N40SISO  | Ant1    | 5230           | 40.720               | 5209.520 | 5250.240 | ---        | ---     |
| 11AC20SISO | Ant1    | 5180           | 20.280               | 5170.000 | 5190.280 | ---        | ---     |
| 11AC20SISO | Ant1    | 5220           | 19.840               | 5210.080 | 5229.920 | ---        | ---     |
| 11AC20SISO | Ant1    | 5240           | 20.120               | 5230.000 | 5250.120 | ---        | ---     |
| 11AC40SISO | Ant1    | 5190           | 40.560               | 5169.680 | 5210.240 | ---        | ---     |
| 11AC40SISO | Ant1    | 5230           | 40.480               | 5209.600 | 5250.080 | ---        | ---     |
| 11AC80SISO | Ant1    | 5210           | 80.160               | 5170.000 | 5250.160 | ---        | ---     |


## Test Graphs

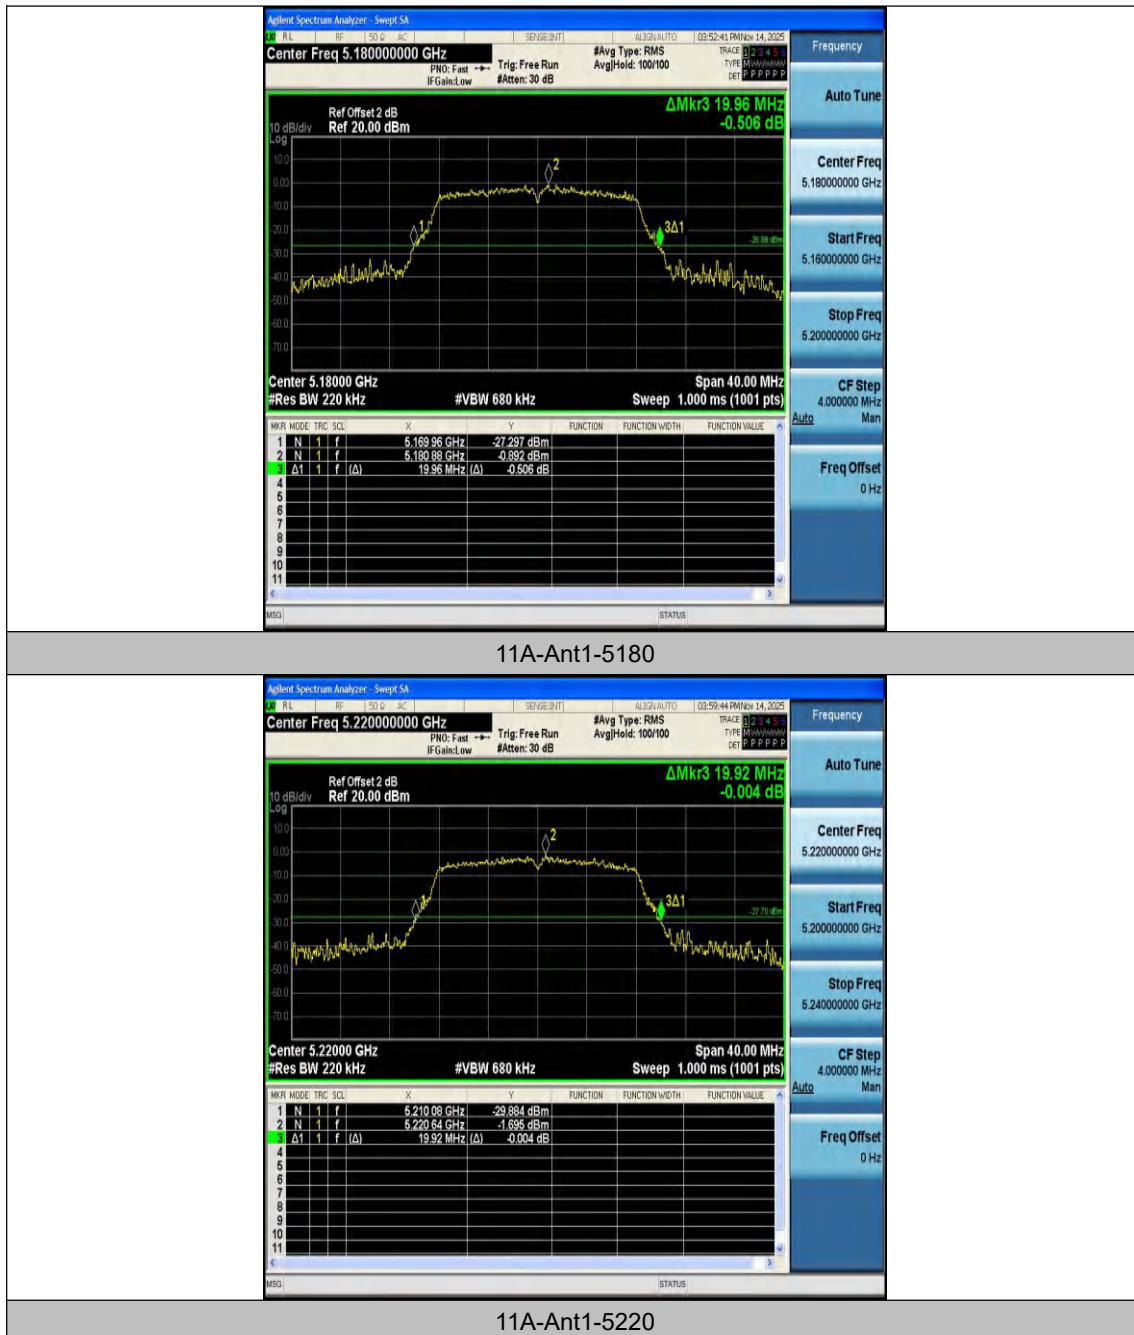

## Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

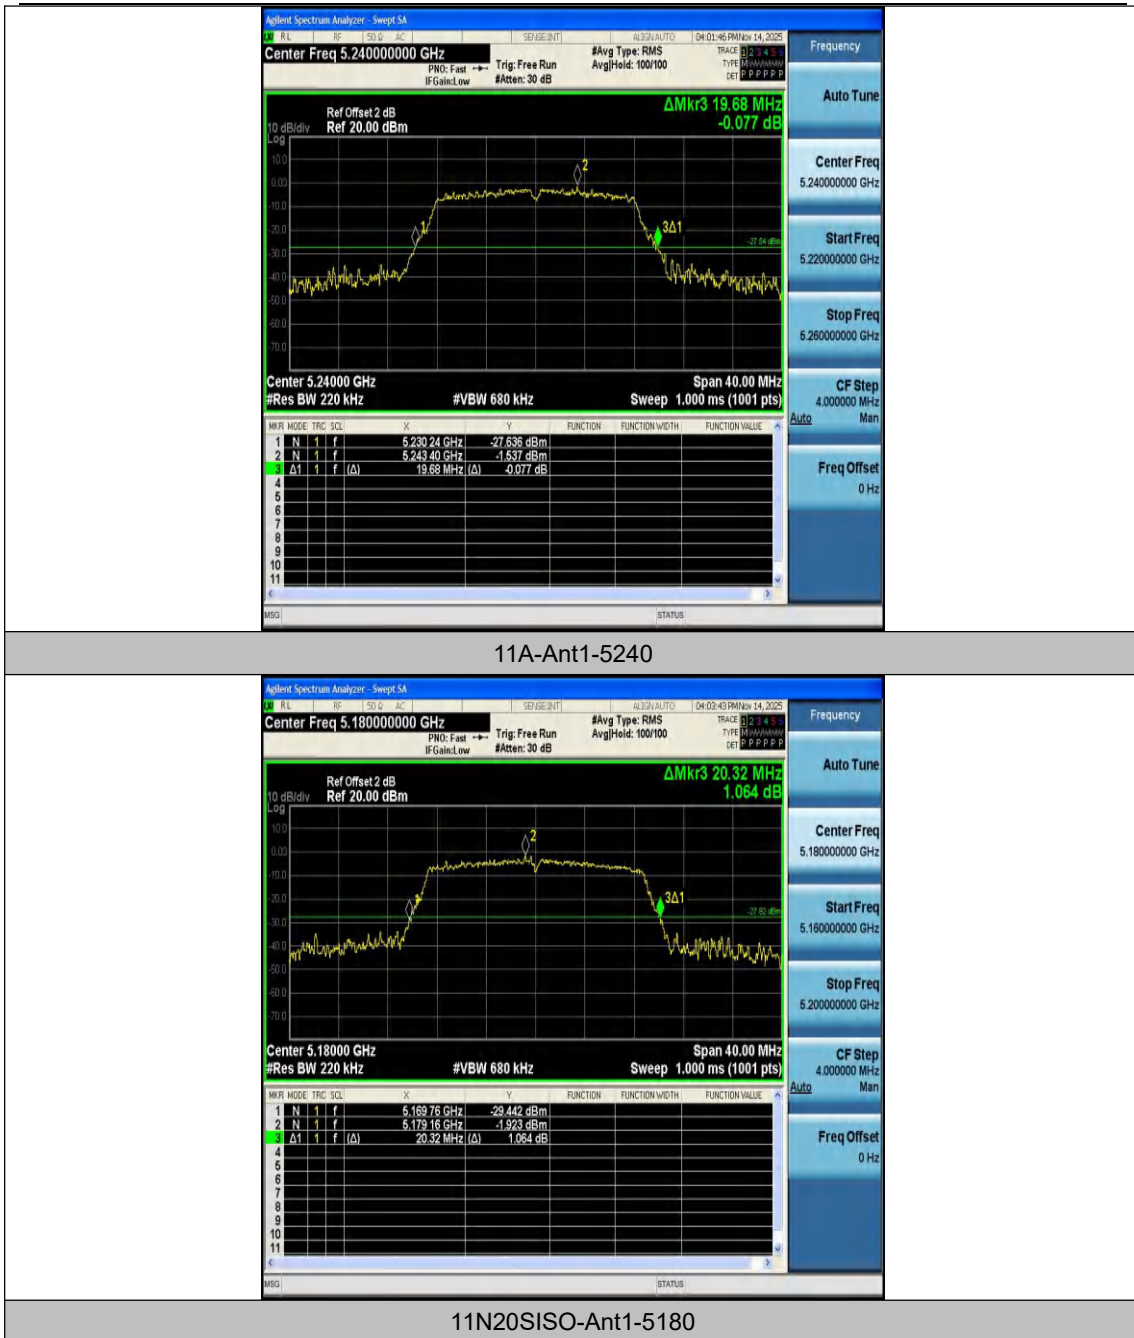

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

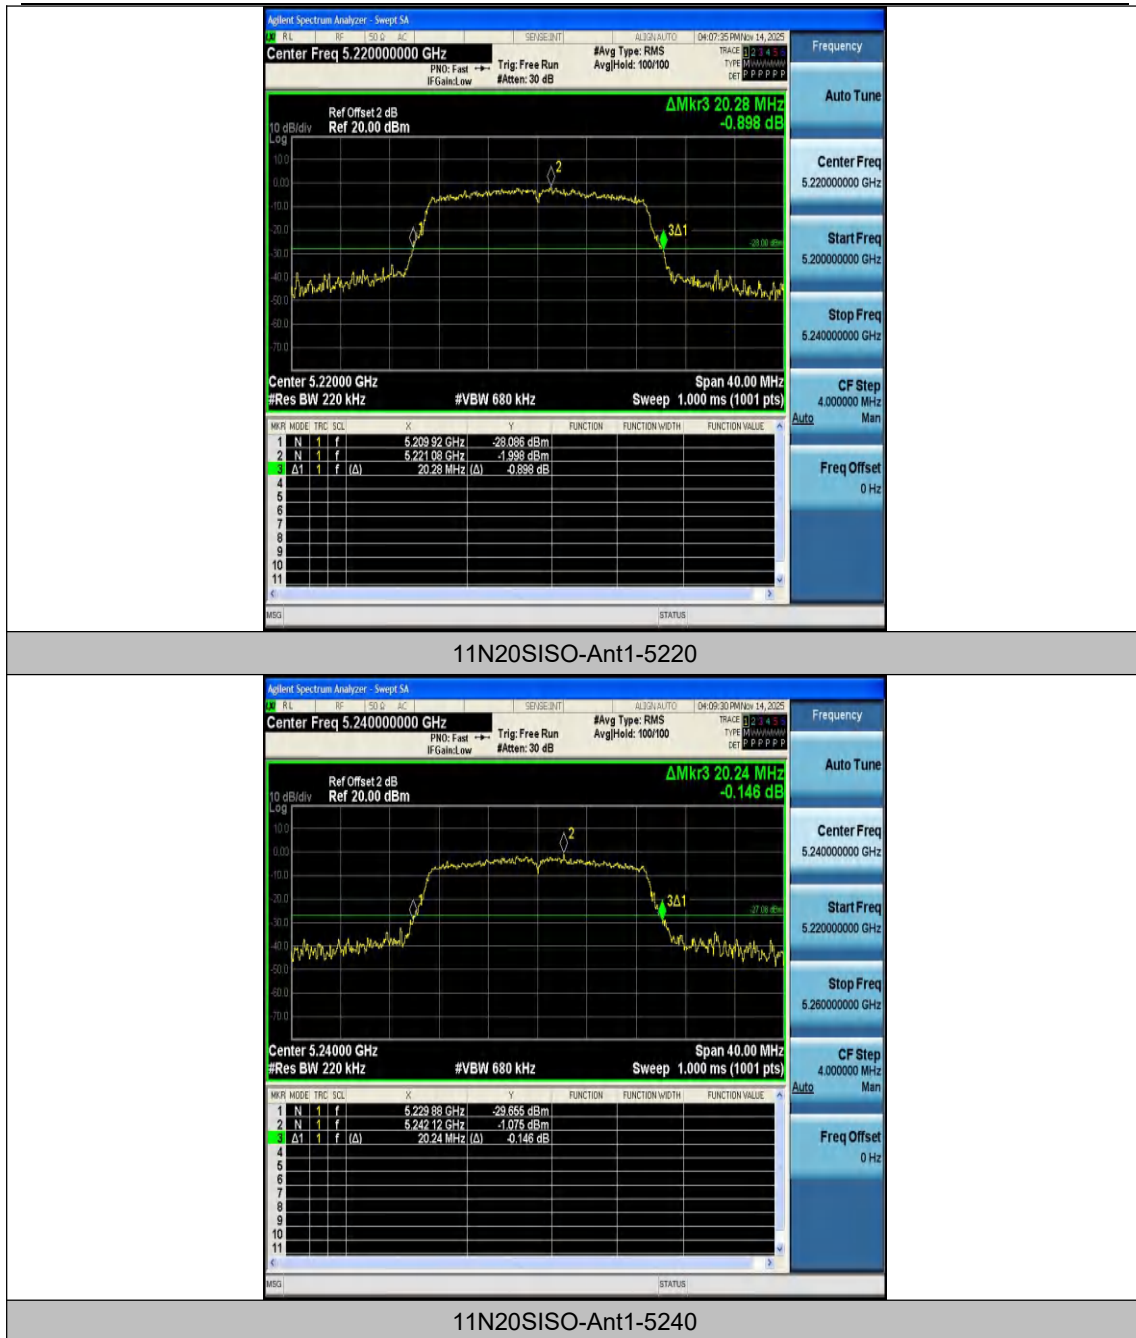

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

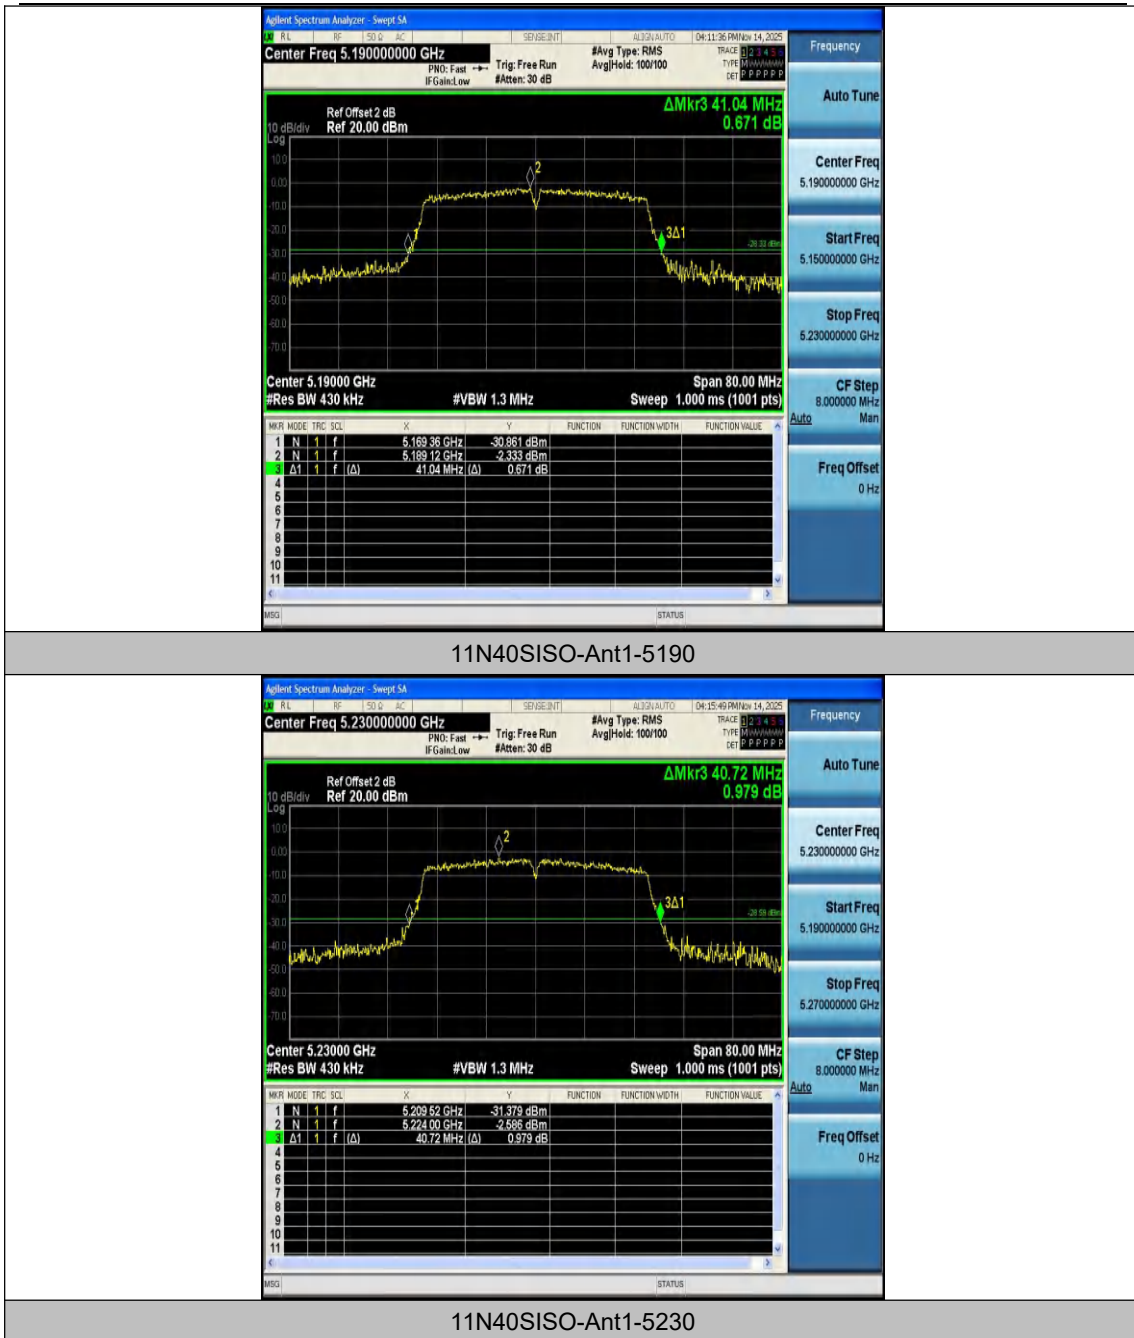

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

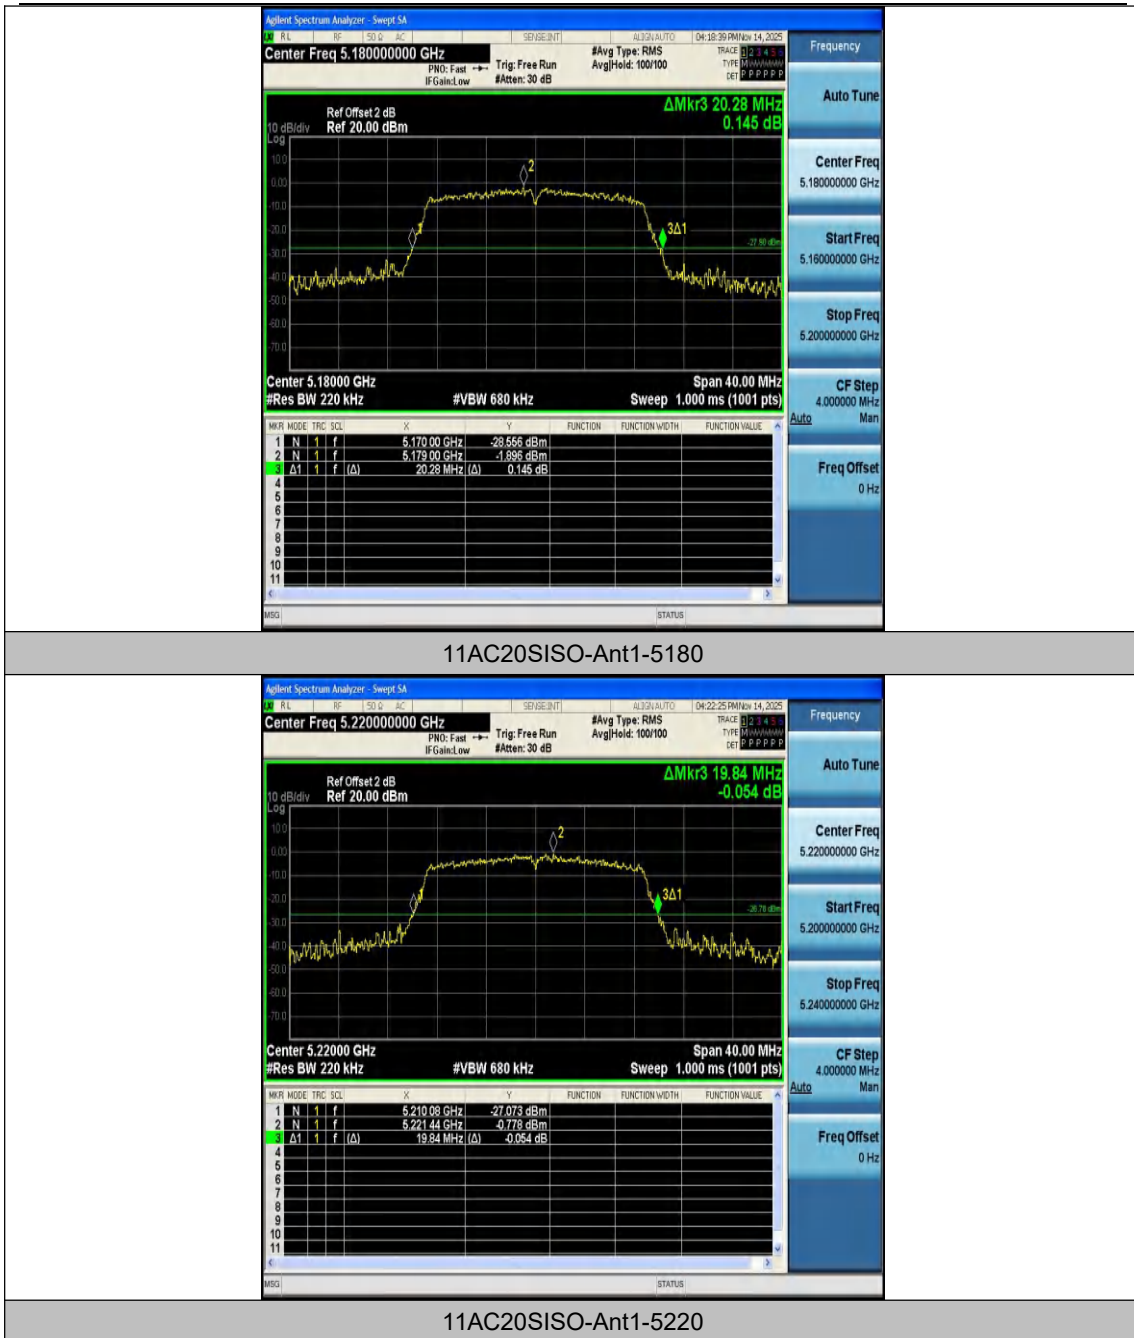

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

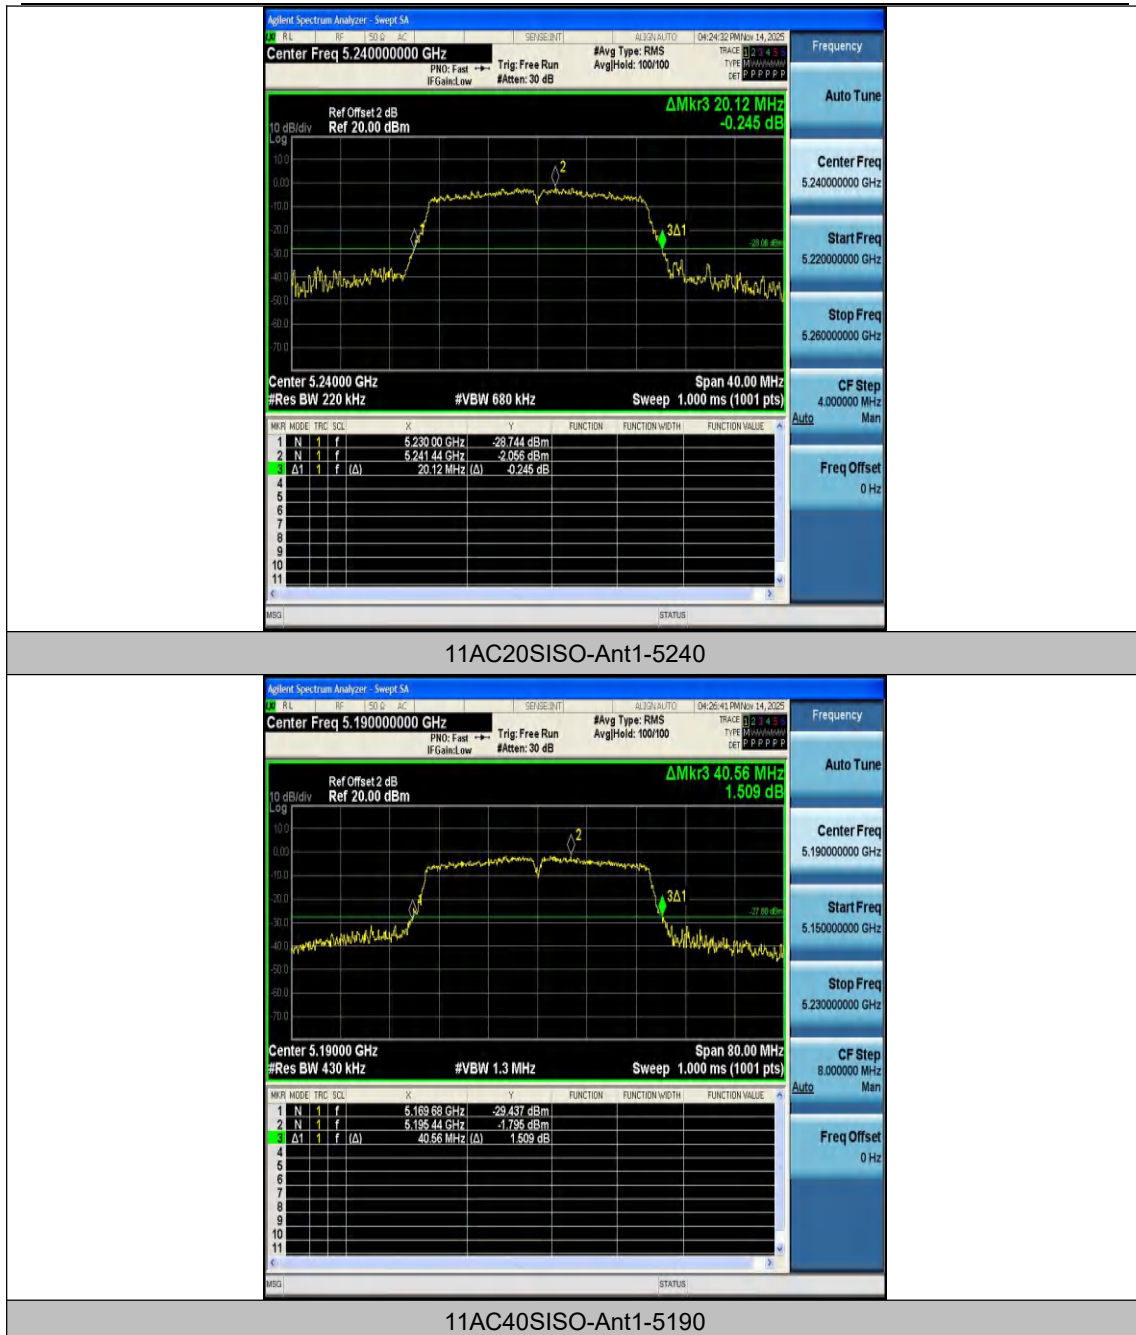

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

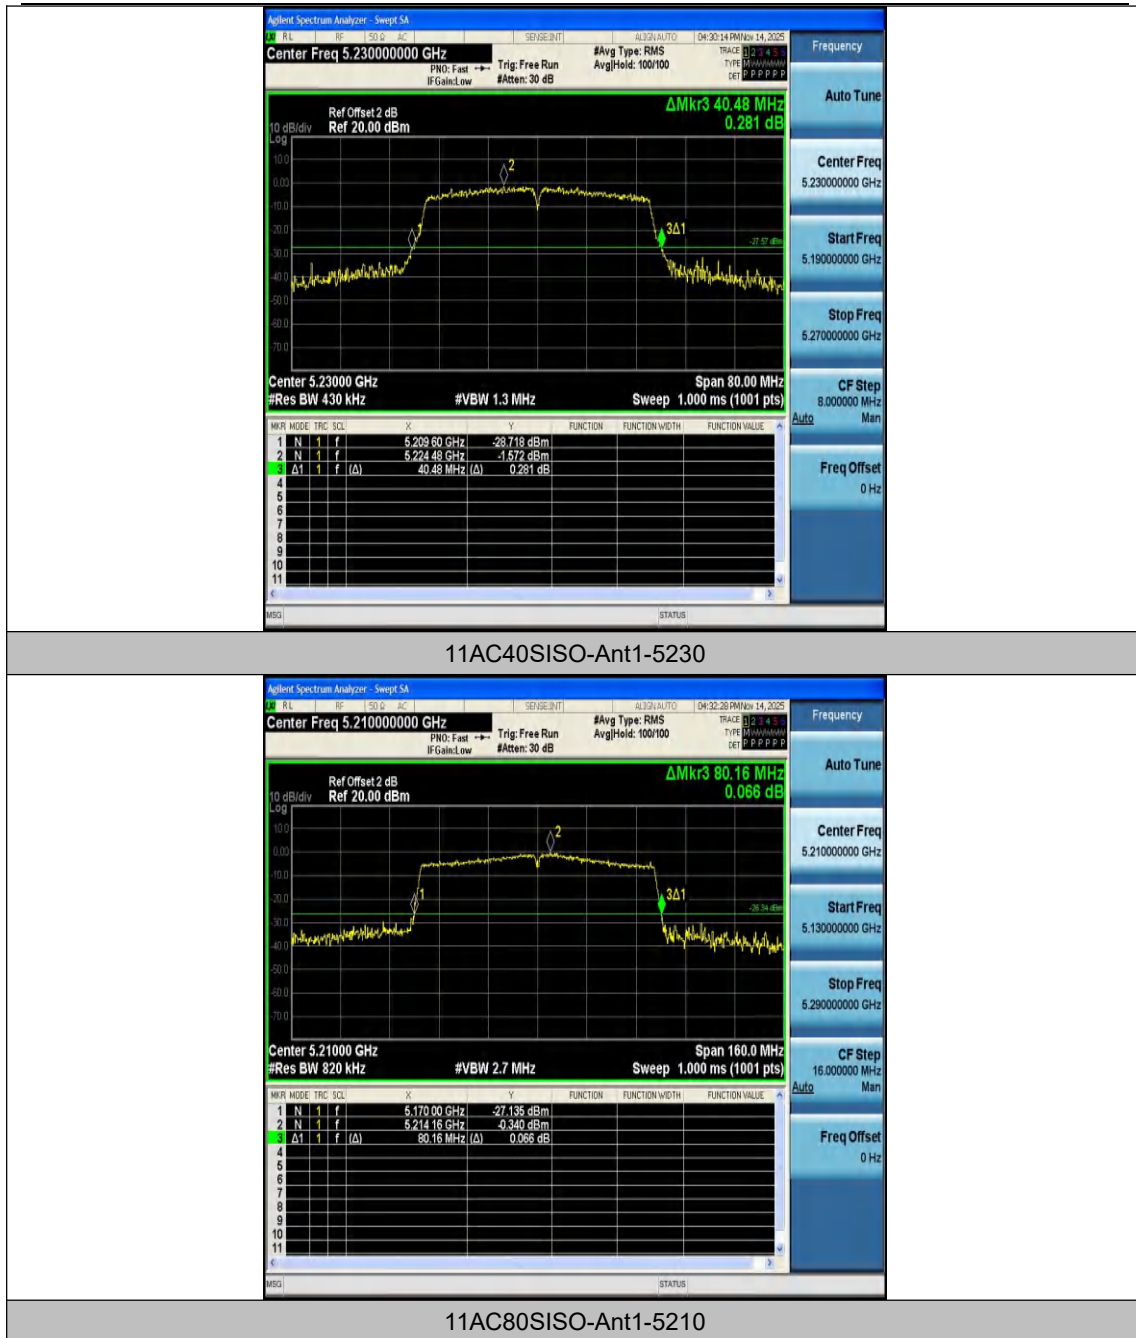

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

## Appendix A2: 99% Occupied Bandwidth

### Test Result

| Test Mode  | Antenna | Frequency[MHz] | OCB [MHz] | FL[MHz]   | FH[MHz]   | Limit[MHz] | Verdict |
|------------|---------|----------------|-----------|-----------|-----------|------------|---------|
| 11A        | Ant1    | 5180           | 16.910    | 5171.5198 | 5188.4298 | ---        | ---     |
| 11A        | Ant1    | 5220           | 16.877    | 5211.5147 | 5228.3917 | ---        | ---     |
| 11A        | Ant1    | 5240           | 16.937    | 5231.5548 | 5248.4918 | ---        | ---     |
| 11N20SISO  | Ant1    | 5180           | 17.896    | 5171.0406 | 5188.9366 | ---        | ---     |
| 11N20SISO  | Ant1    | 5220           | 17.866    | 5211.0423 | 5228.9083 | ---        | ---     |
| 11N20SISO  | Ant1    | 5240           | 17.908    | 5231.0712 | 5248.9792 | ---        | ---     |
| 11N40SISO  | Ant1    | 5190           | 36.474    | 5171.8086 | 5208.2826 | ---        | ---     |
| 11N40SISO  | Ant1    | 5230           | 36.388    | 5211.7624 | 5248.1504 | ---        | ---     |
| 11AC20SISO | Ant1    | 5180           | 17.909    | 5171.0219 | 5188.9309 | ---        | ---     |
| 11AC20SISO | Ant1    | 5220           | 17.831    | 5211.0454 | 5228.8764 | ---        | ---     |
| 11AC20SISO | Ant1    | 5240           | 17.924    | 5231.0567 | 5248.9807 | ---        | ---     |
| 11AC40SISO | Ant1    | 5190           | 36.431    | 5171.7962 | 5208.2272 | ---        | ---     |
| 11AC40SISO | Ant1    | 5230           | 36.367    | 5211.7702 | 5248.1372 | ---        | ---     |
| 11AC80SISO | Ant1    | 5210           | 75.320    | 5172.3099 | 5247.6299 | ---        | ---     |


## Test Graphs

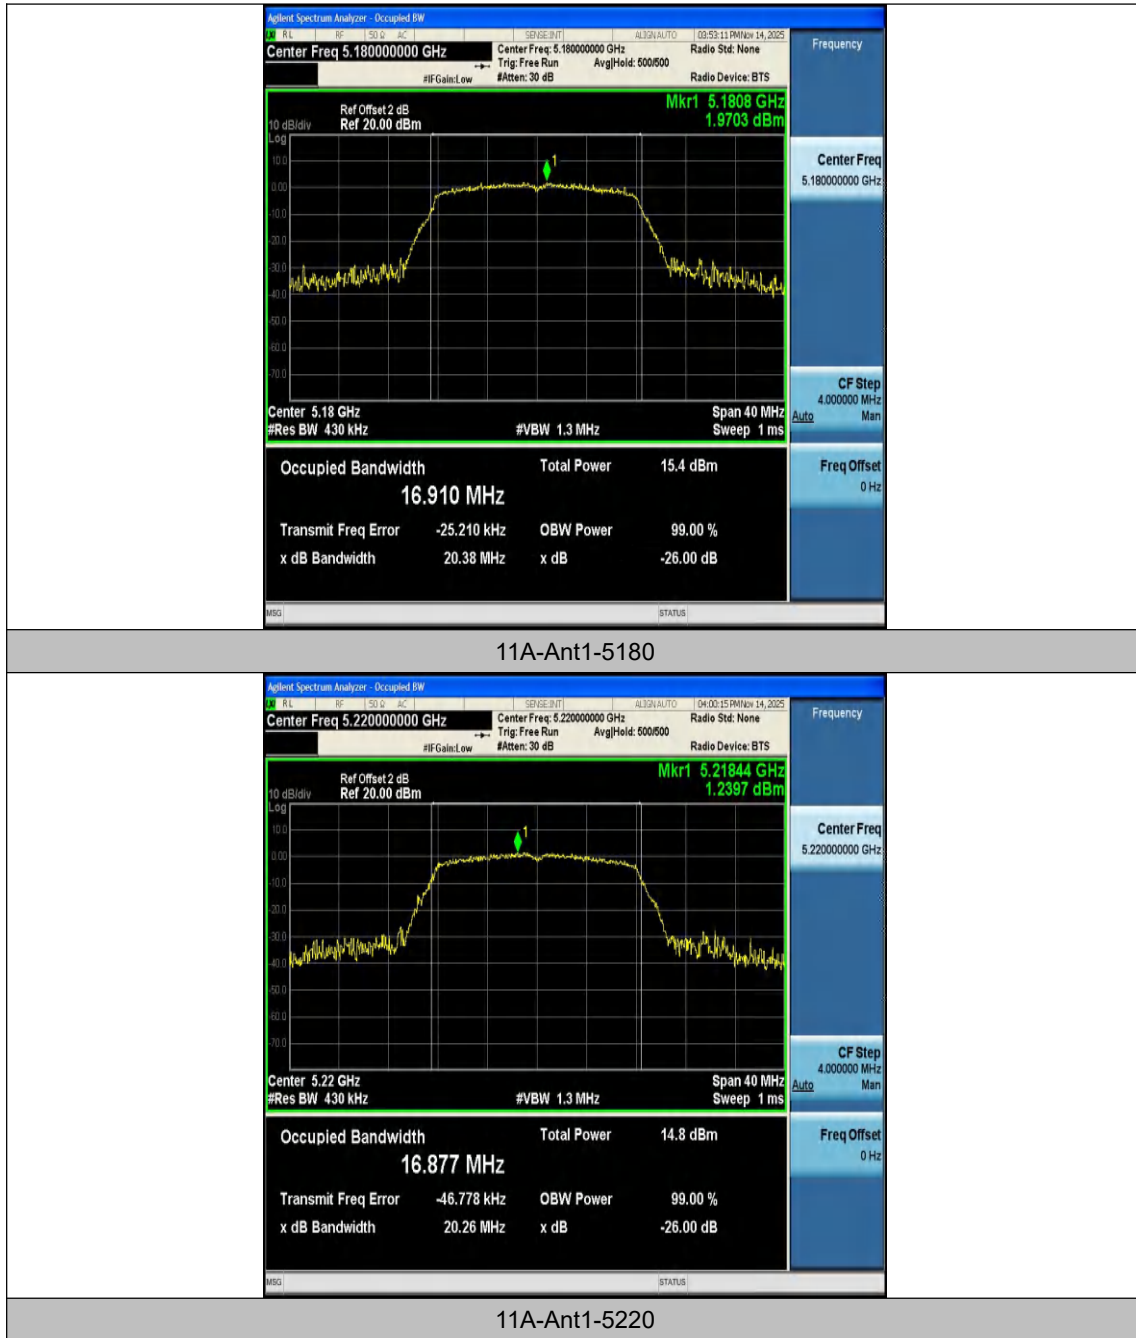

## Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

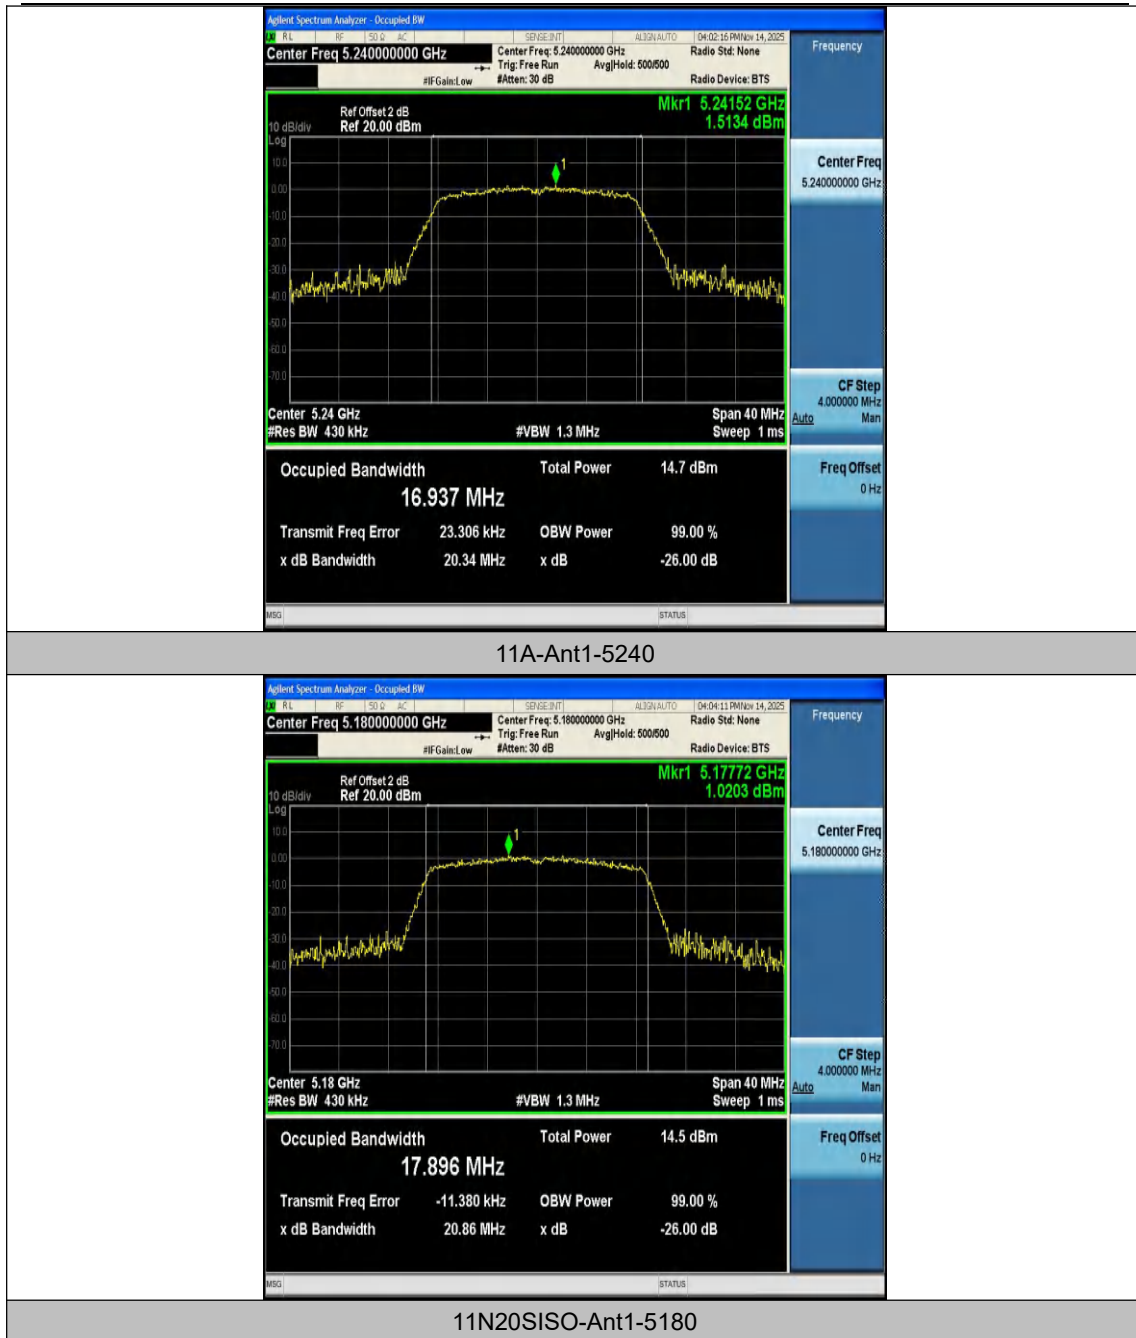

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

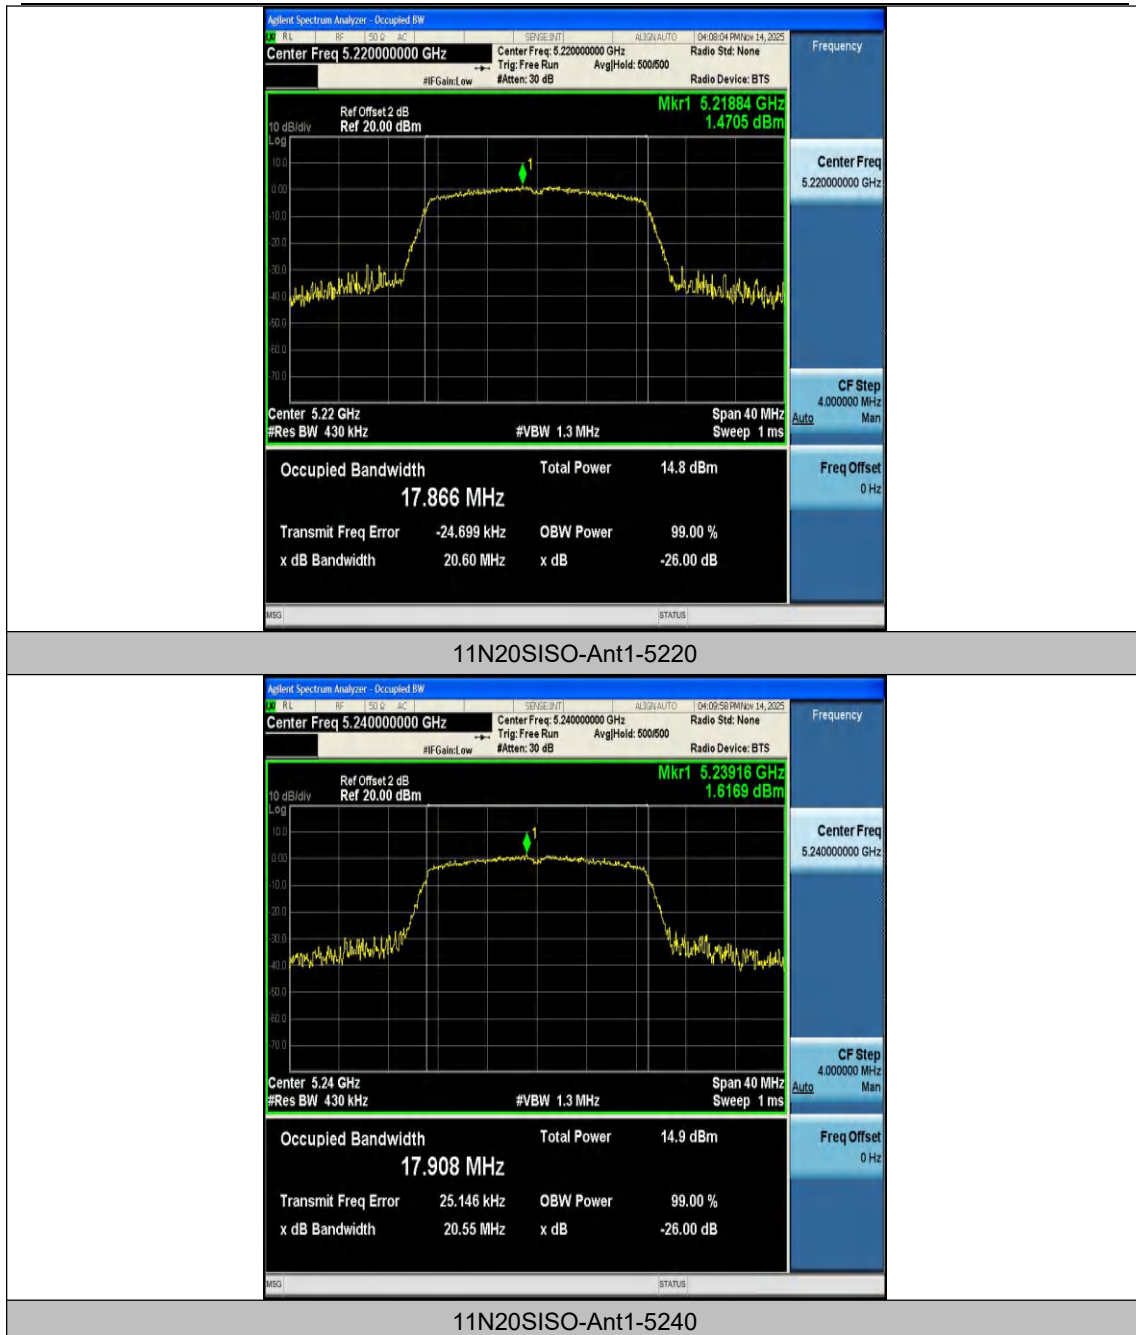

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

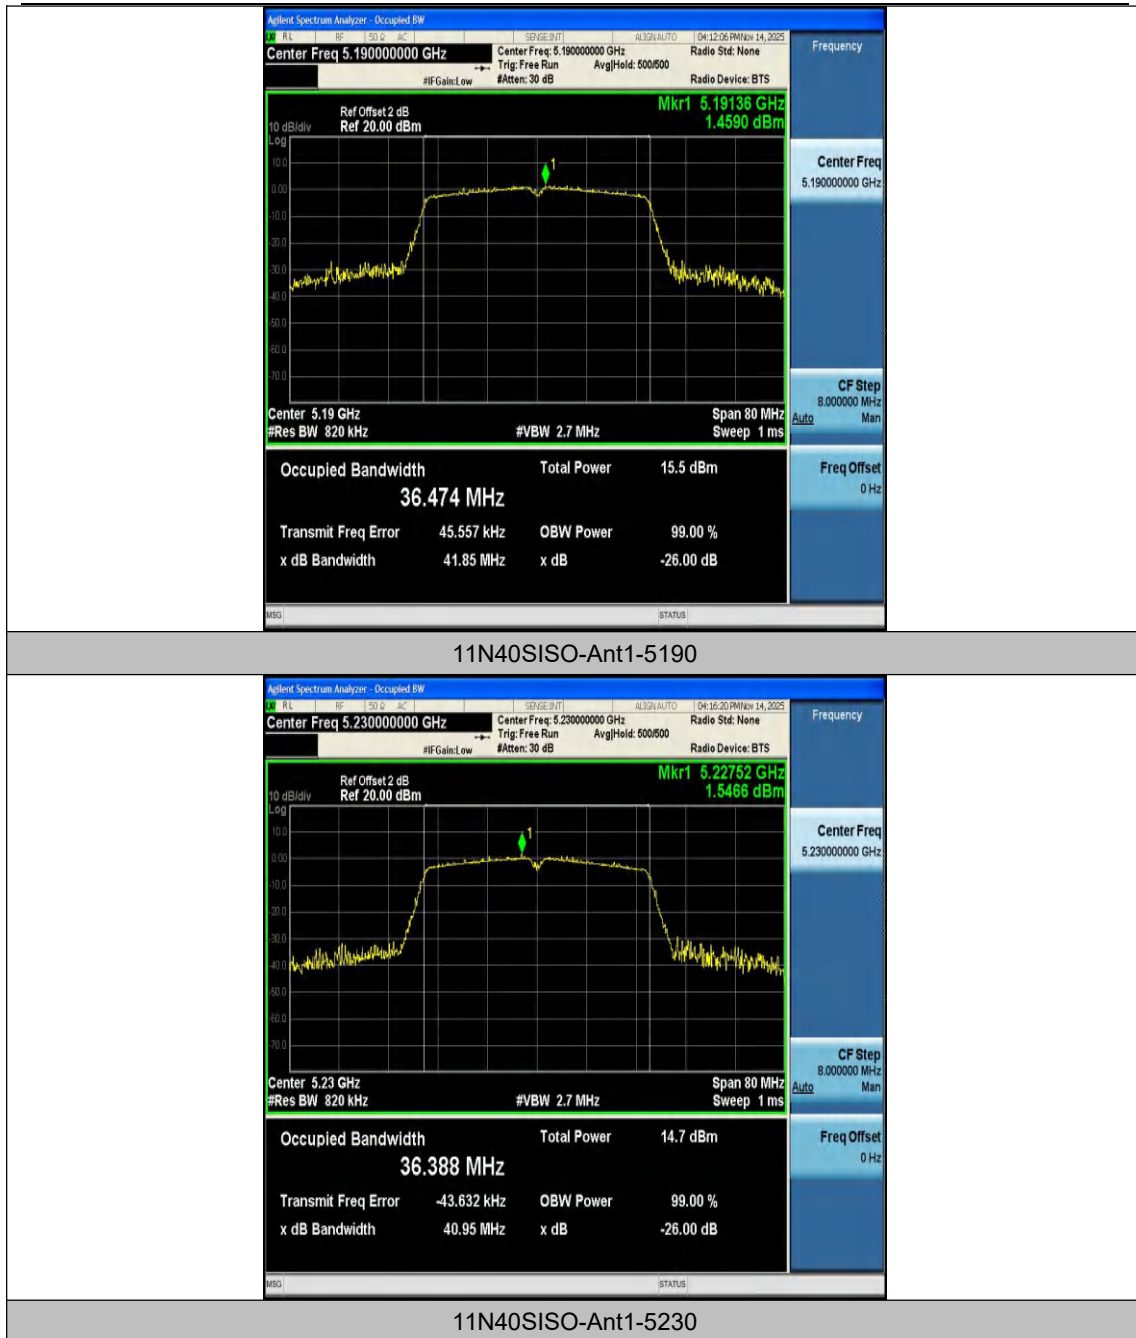

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

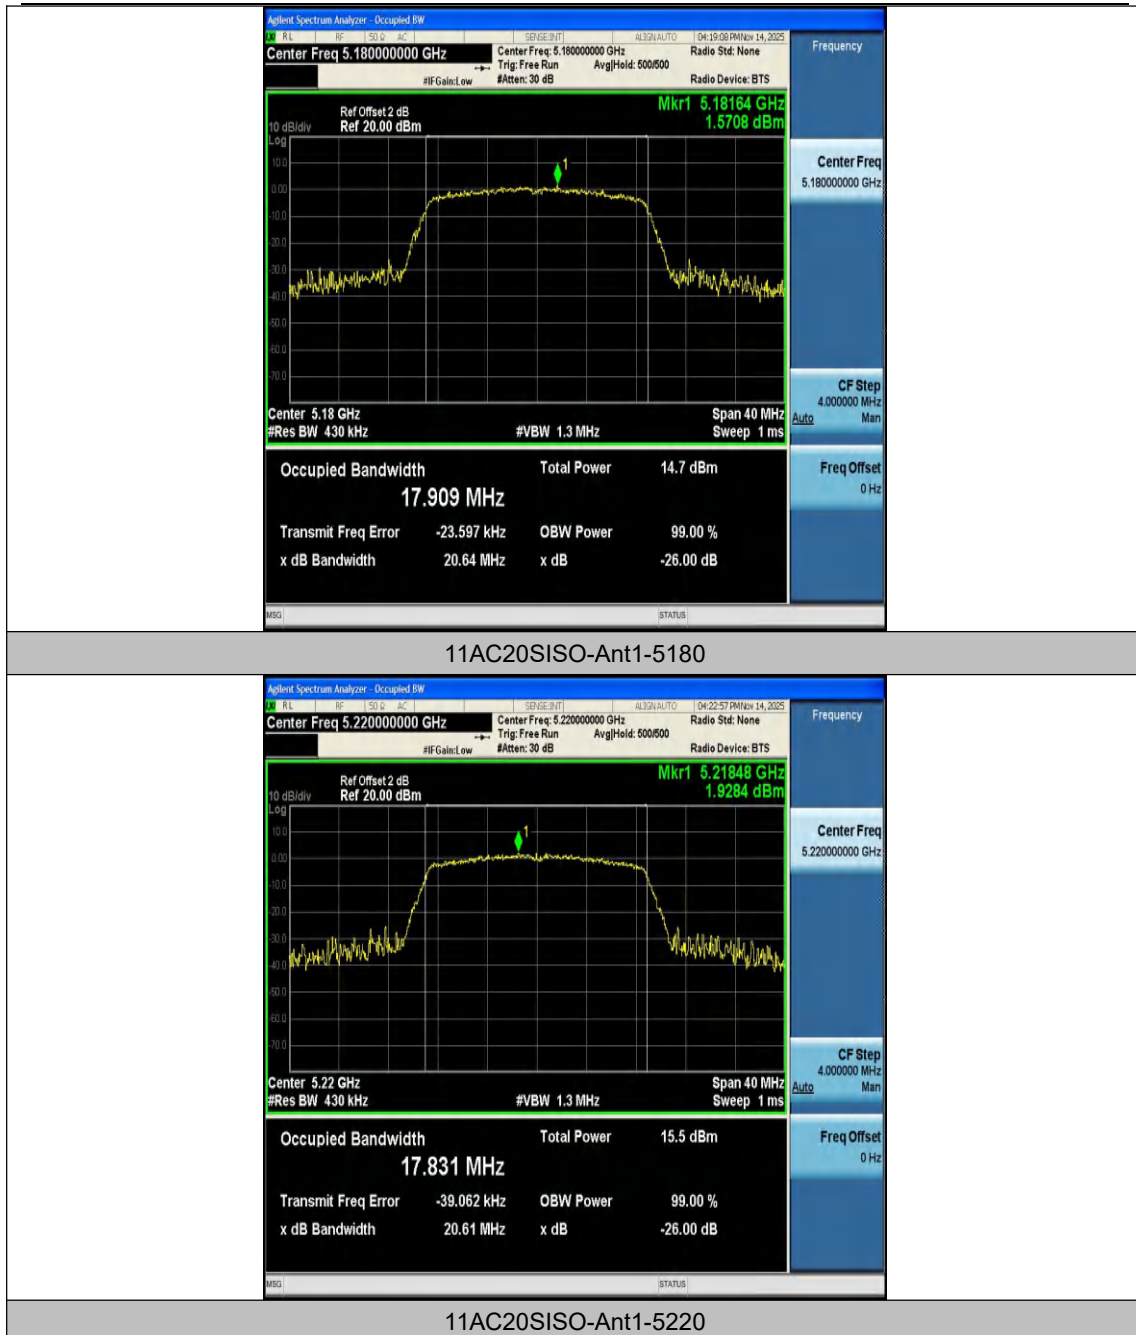

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

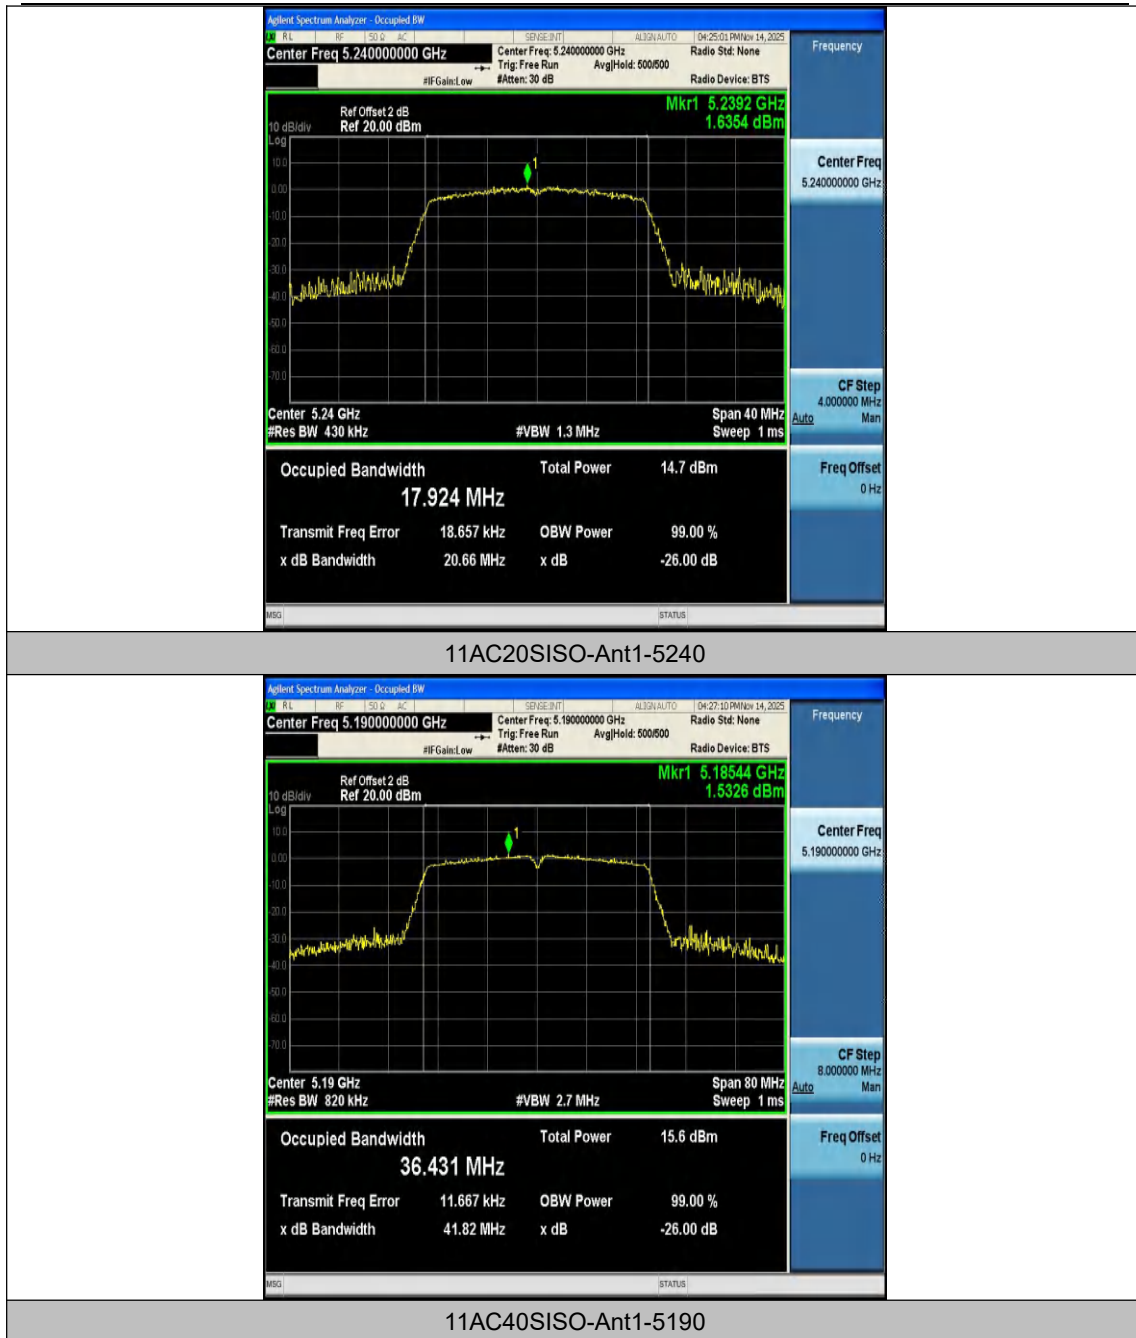

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

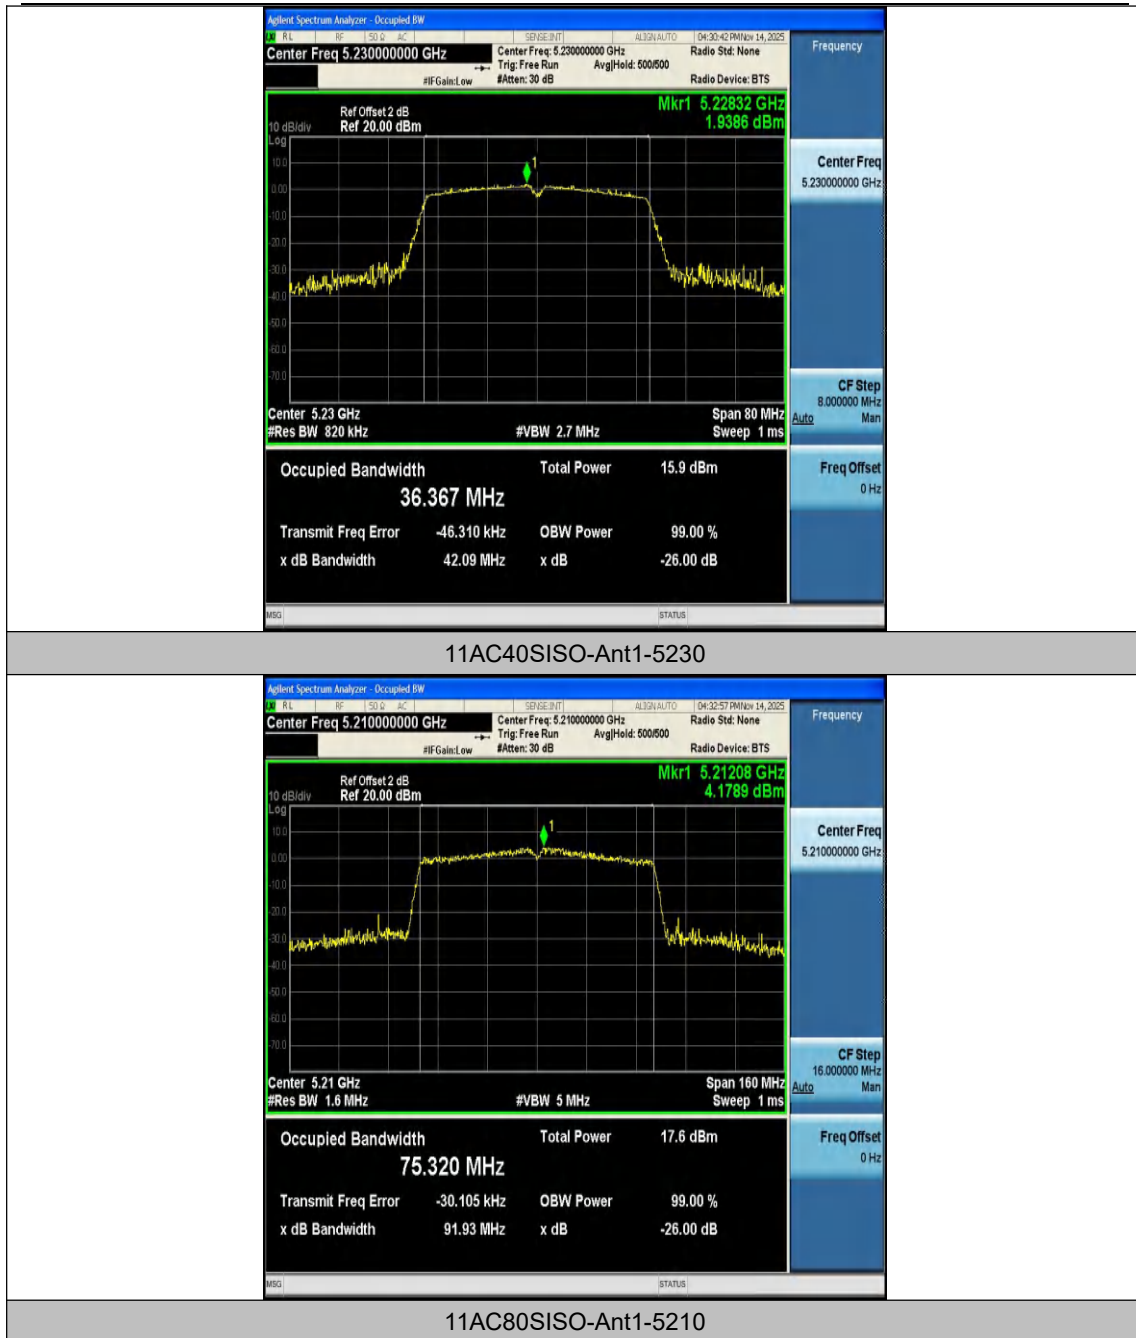

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

## Appendix B: Duty Cycle

### Test Result

| Test Mode  | Antenna | Frequency[MHz] | Transmission Duration [ms] | Transmission Period [ms] | Duty Cycle [%] | Dc Factor [dB] | 1/T  |
|------------|---------|----------------|----------------------------|--------------------------|----------------|----------------|------|
| 11A        | Ant1    | 5180           | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11A        | Ant1    | 5220           | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11A        | Ant1    | 5240           | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11N20SISO  | Ant1    | 5180           | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11N20SISO  | Ant1    | 5220           | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11N20SISO  | Ant1    | 5240           | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11N40SISO  | Ant1    | 5190           | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11N40SISO  | Ant1    | 5230           | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11AC20SISO | Ant1    | 5180           | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11AC20SISO | Ant1    | 5220           | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11AC20SISO | Ant1    | 5240           | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11AC40SISO | Ant1    | 5190           | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11AC40SISO | Ant1    | 5230           | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |
| 11AC80SISO | Ant1    | 5210           | 100.00                     | 100.00                   | 100.00         | 0.00           | 0.01 |


## Test Graphs

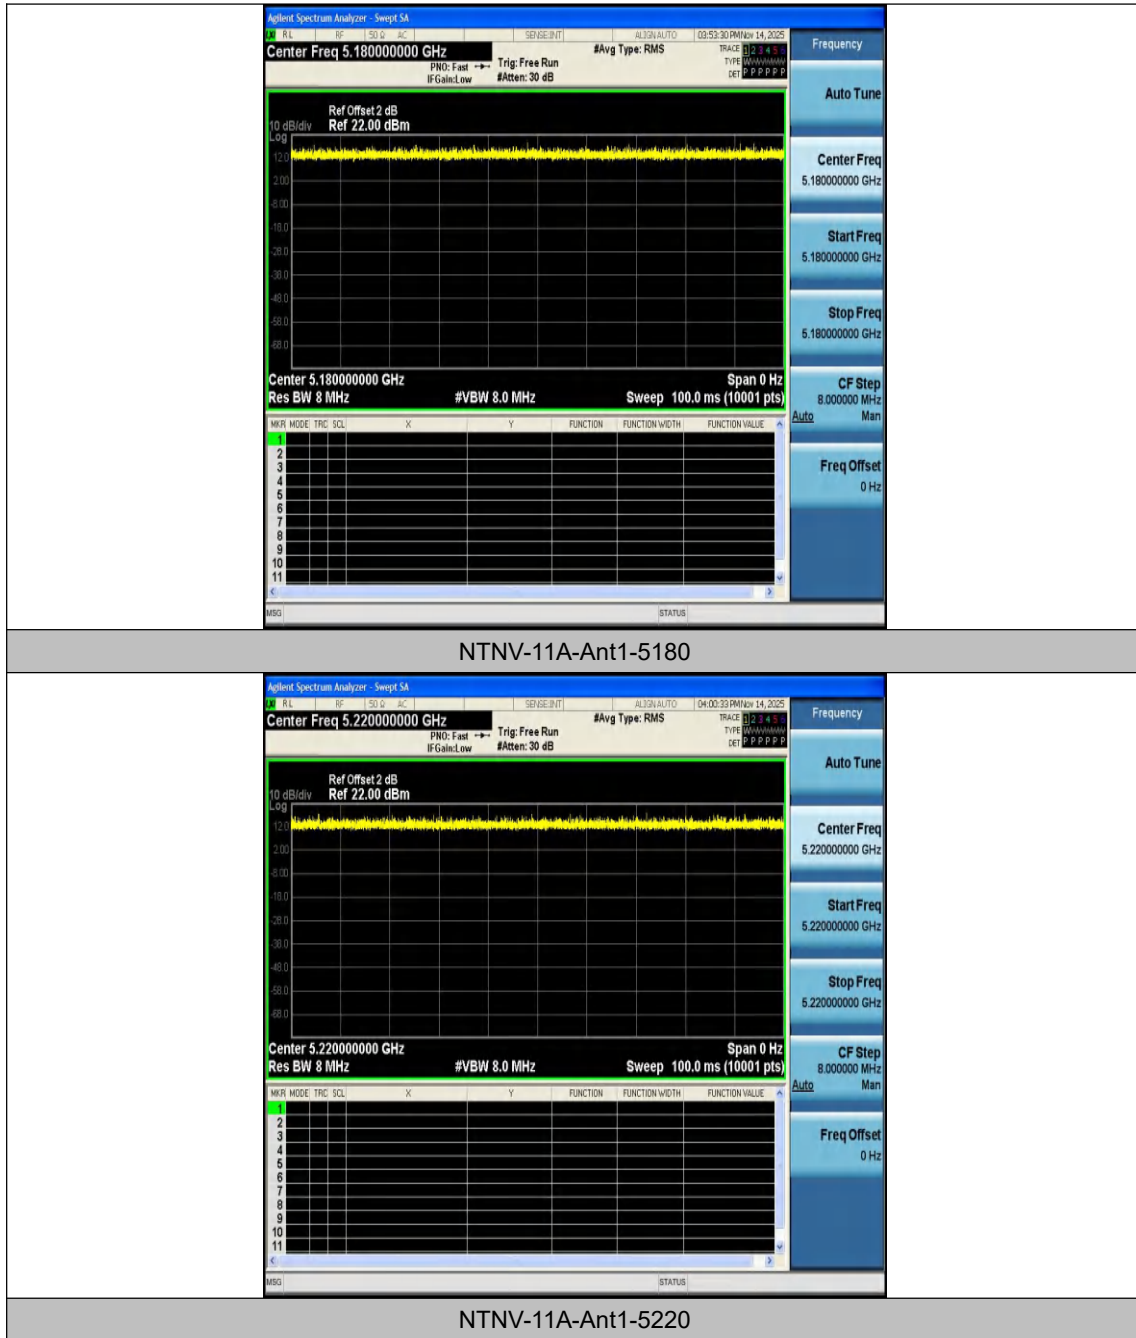

## Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

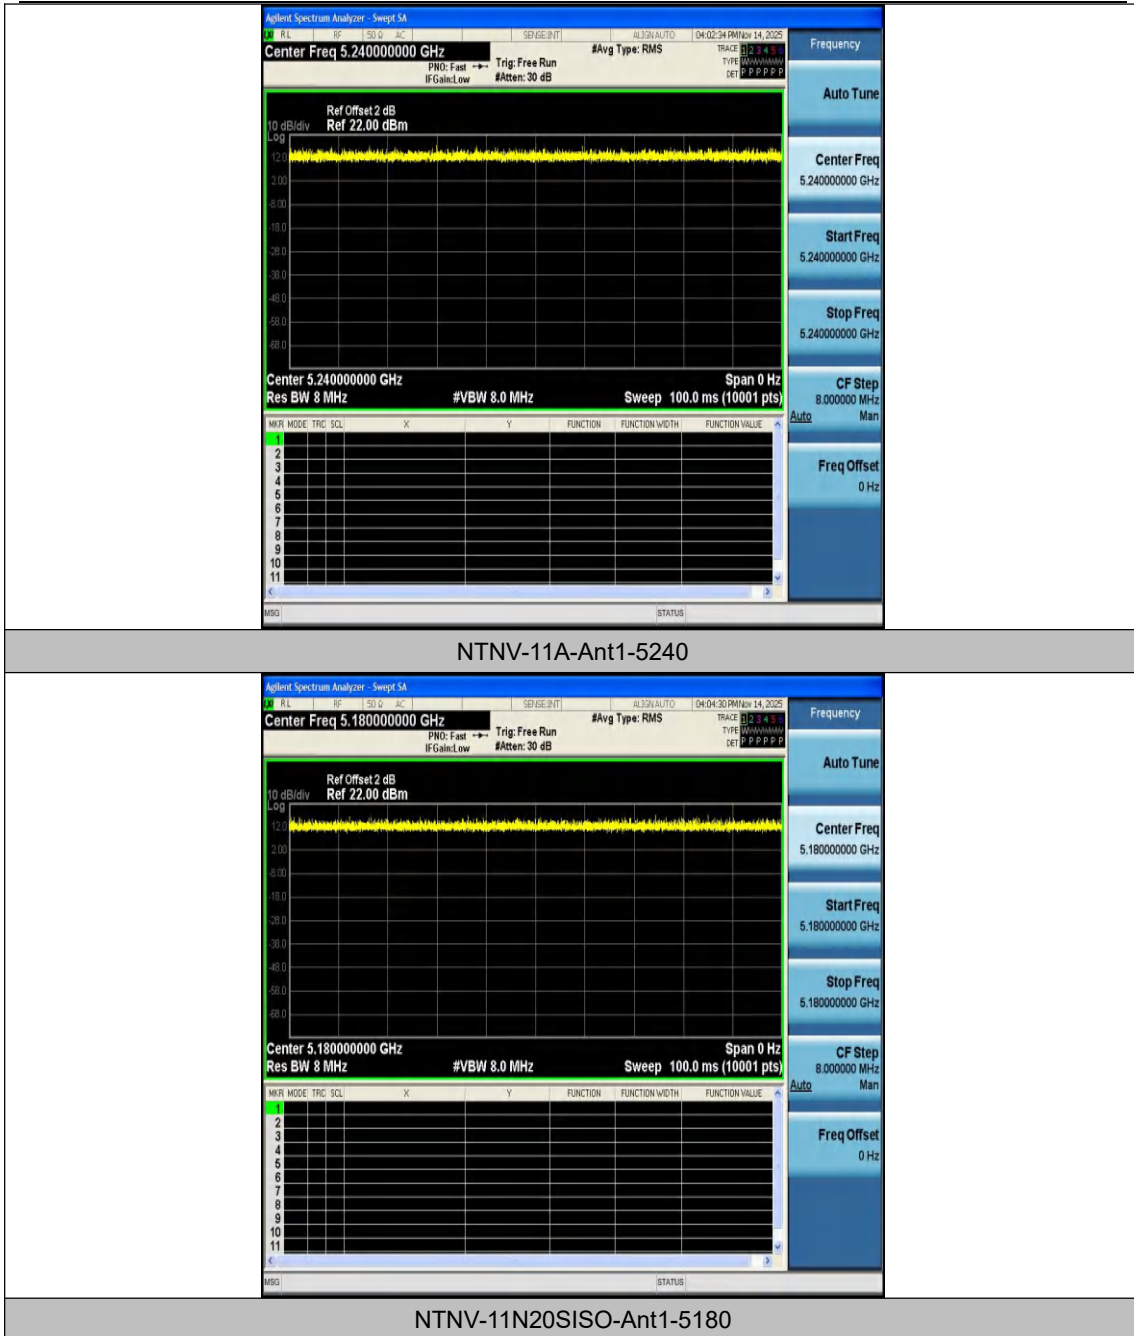

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

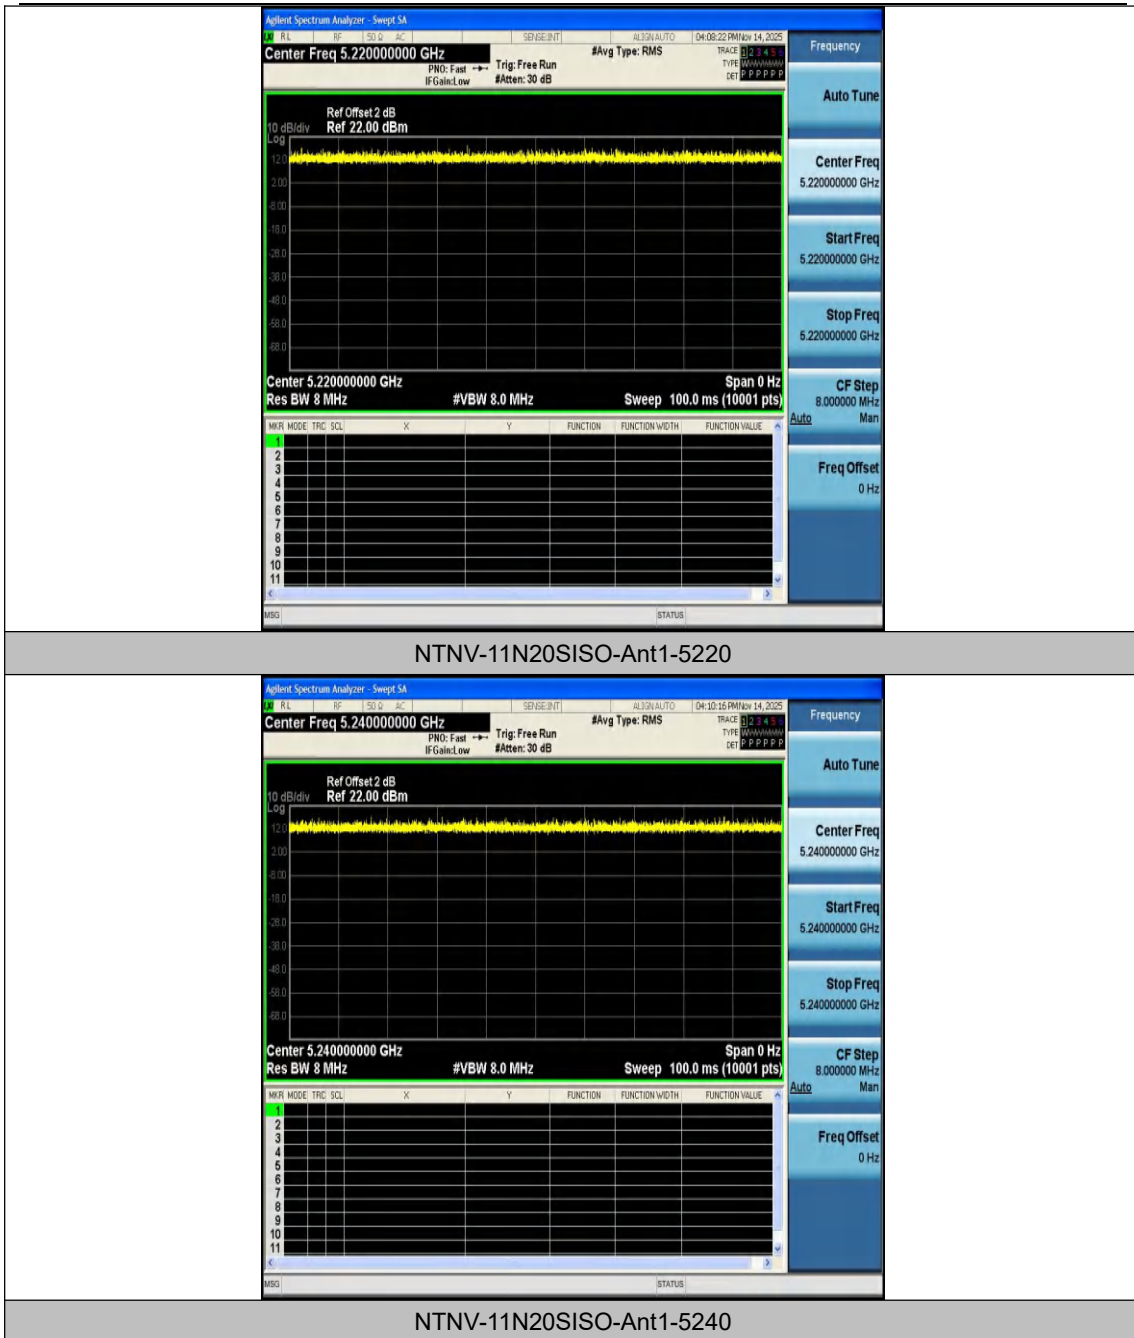

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

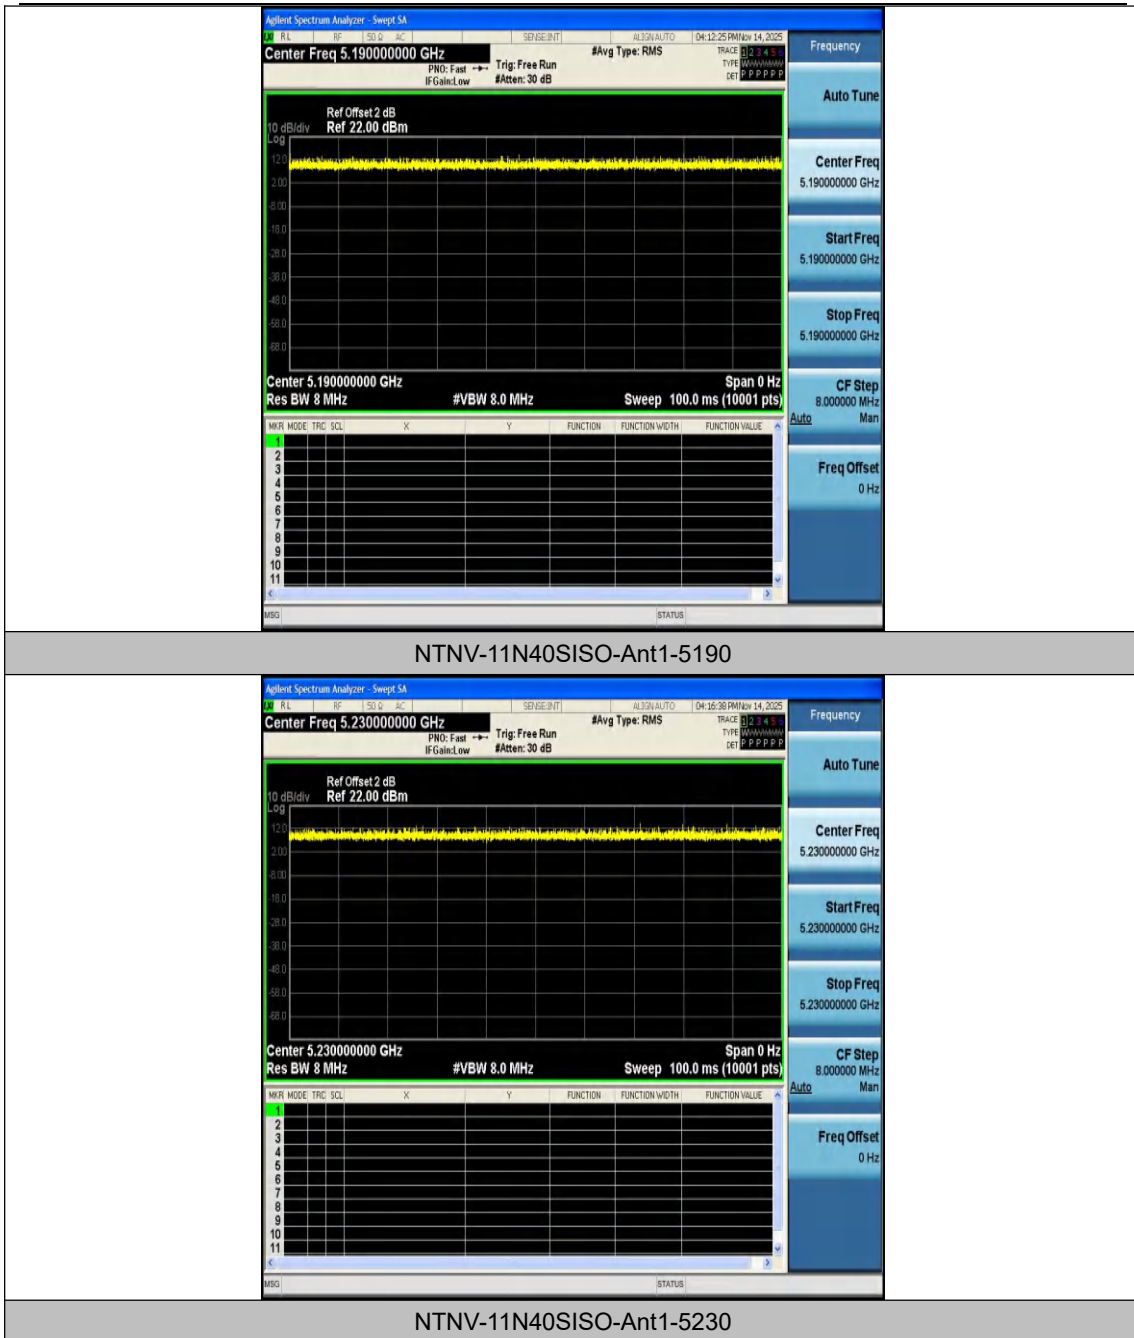

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

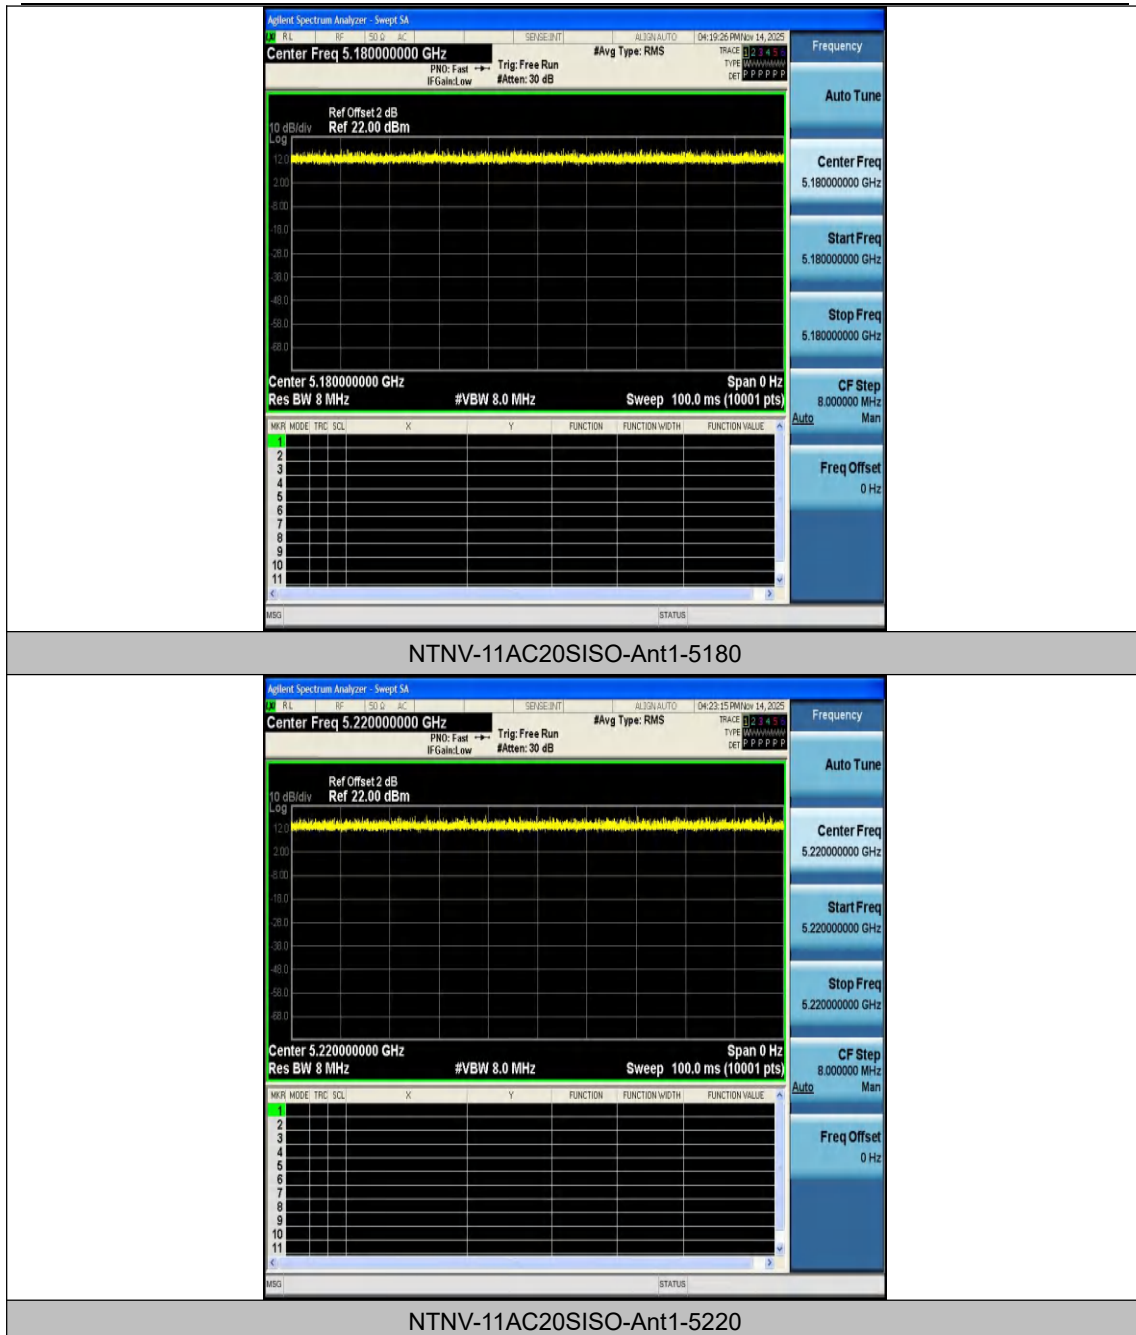

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

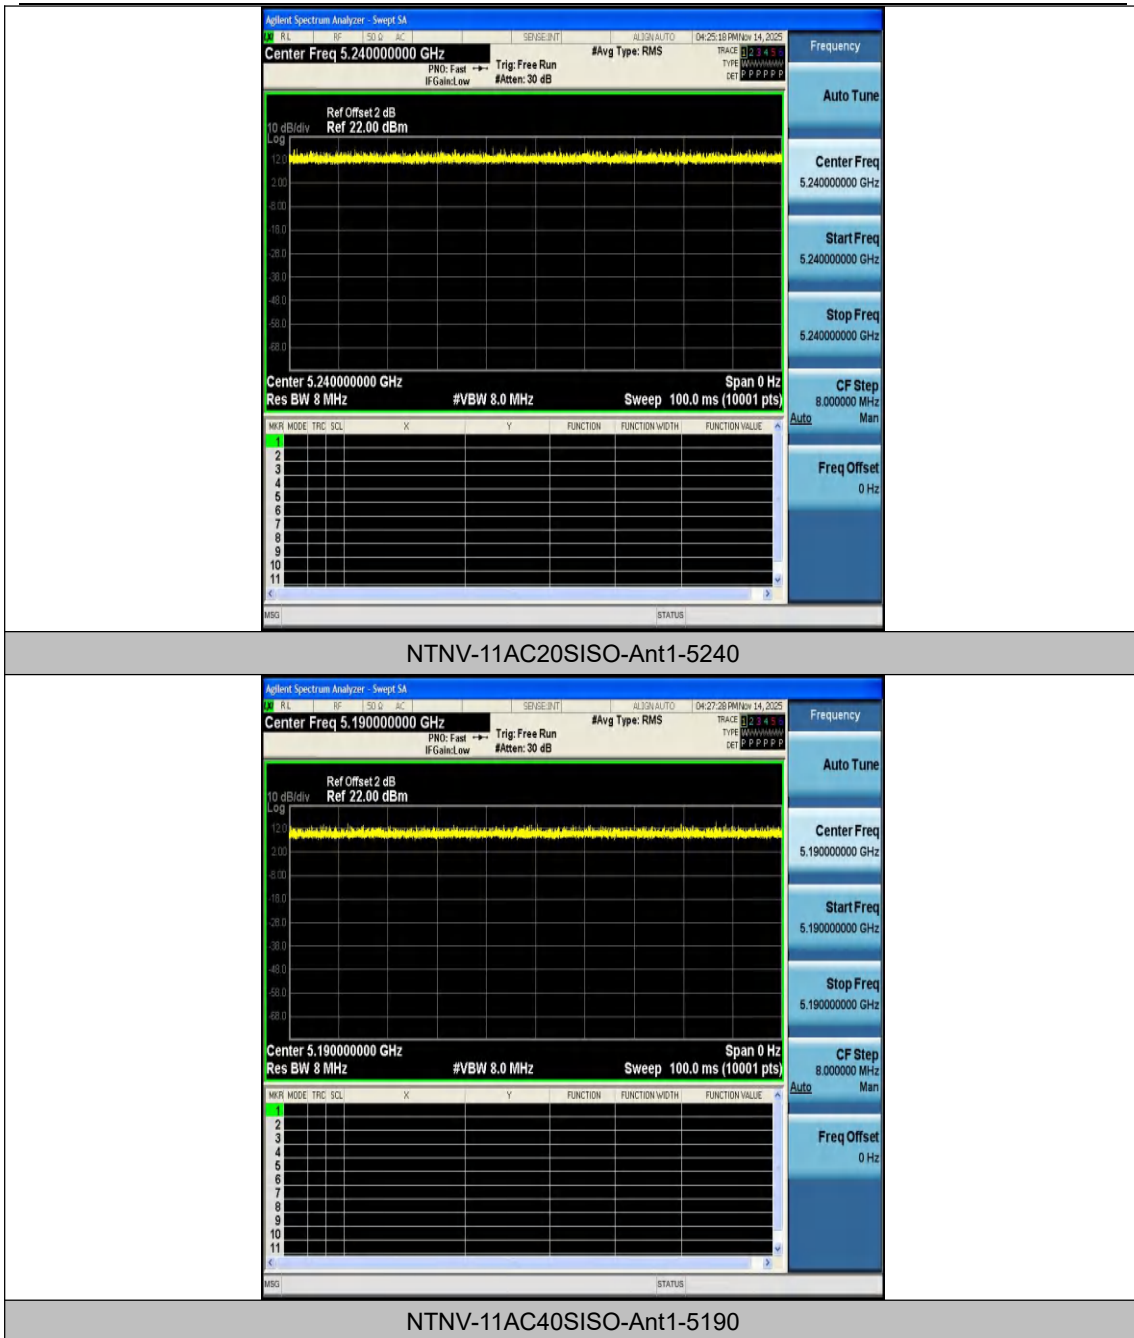

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

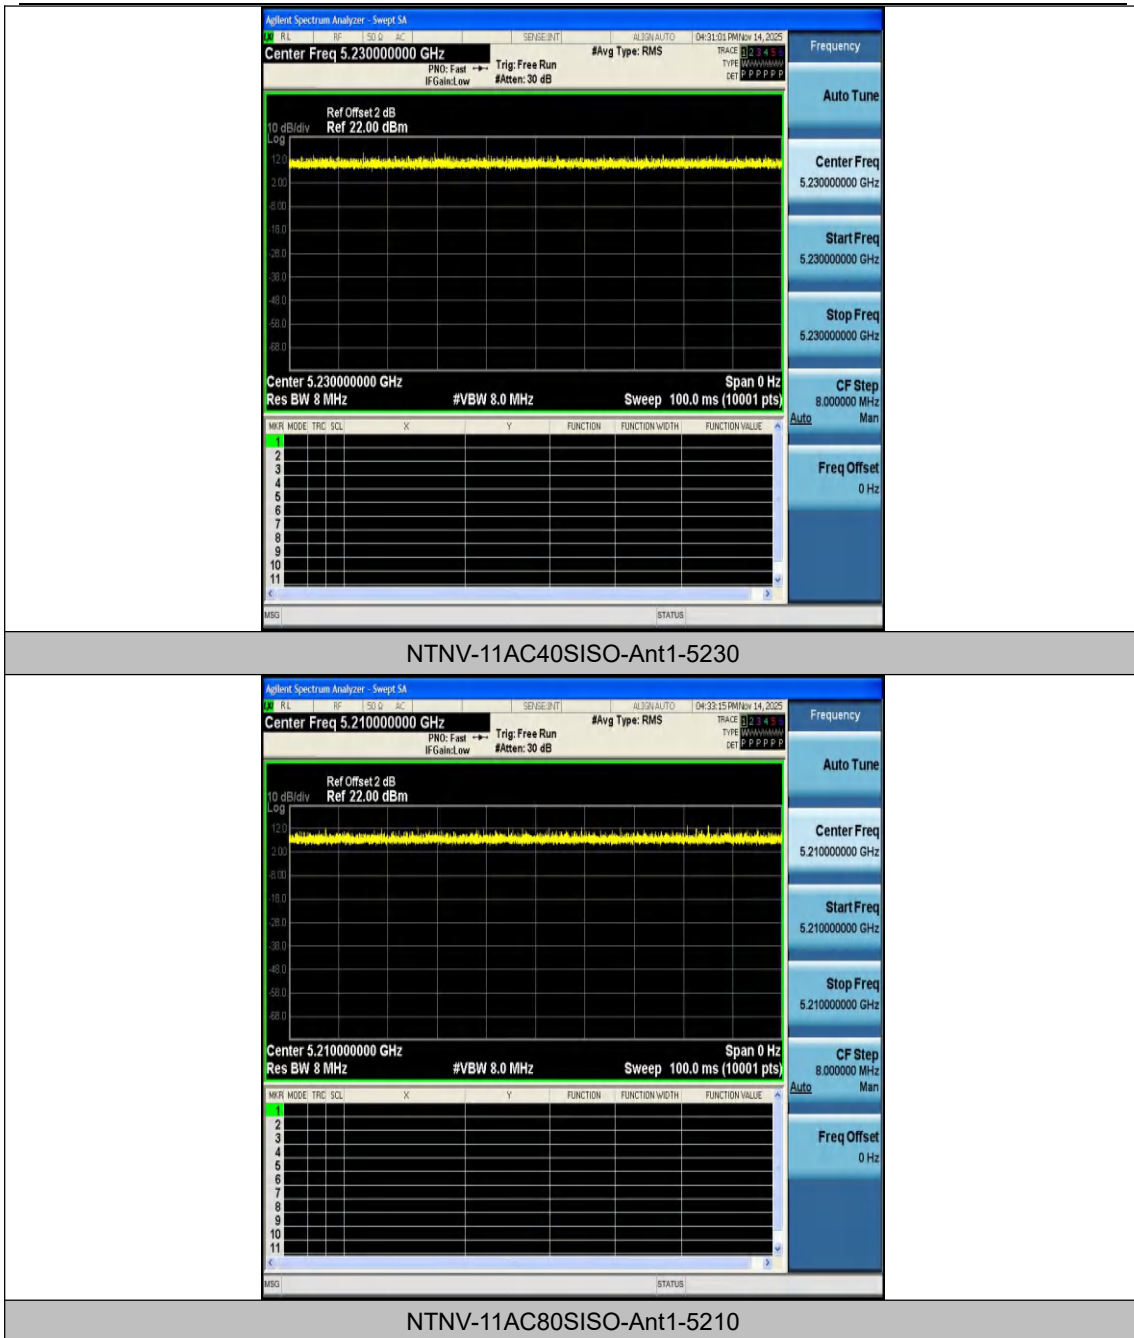

**Shenzhen Anbotek Compliance Laboratory Limited**

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


## Appendix C: Maximum Conducted Output Power

### Test Result Channel Power

| Test Mode   | Antenna | Frequency [MHz] | Set Power | Channel Power [dBm] | Duty Cycle [%] | DC Factor [dB] | Result [dBm] | Limit [dBm] | Verdict |
|-------------|---------|-----------------|-----------|---------------------|----------------|----------------|--------------|-------------|---------|
| 11A         | Ant1    | 5180            | ---       | 13.49               | 100.00         | 0.00           | 13.49        | ≤23.98      | PASS    |
| 11A         | Ant1    | 5220            | ---       | 13.08               | 100.00         | 0.00           | 13.08        | ≤23.98      | PASS    |
| 11A         | Ant1    | 5240            | ---       | 12.77               | 100.00         | 0.00           | 12.77        | ≤23.98      | PASS    |
| 11N20SI SO  | Ant1    | 5180            | ---       | 12.61               | 100.00         | 0.00           | 12.61        | ≤23.98      | PASS    |
| 11N20SI SO  | Ant1    | 5220            | ---       | 12.89               | 100.00         | 0.00           | 12.89        | ≤23.98      | PASS    |
| 11N20SI SO  | Ant1    | 5240            | ---       | 12.98               | 100.00         | 0.00           | 12.98        | ≤23.98      | PASS    |
| 11N40SI SO  | Ant1    | 5190            | ---       | 13.12               | 100.00         | 0.00           | 13.12        | ≤23.98      | PASS    |
| 11N40SI SO  | Ant1    | 5230            | ---       | 12.39               | 100.00         | 0.00           | 12.39        | ≤23.98      | PASS    |
| 11AC20S ISO | Ant1    | 5180            | ---       | 12.78               | 100.00         | 0.00           | 12.78        | ≤23.98      | PASS    |
| 11AC20S ISO | Ant1    | 5220            | ---       | 13.61               | 100.00         | 0.00           | 13.61        | ≤23.98      | PASS    |
| 11AC20S ISO | Ant1    | 5240            | ---       | 12.81               | 100.00         | 0.00           | 12.81        | ≤23.98      | PASS    |
| 11AC40S ISO | Ant1    | 5190            | ---       | 13.26               | 100.00         | 0.00           | 13.26        | ≤23.98      | PASS    |
| 11AC40S ISO | Ant1    | 5230            | ---       | 13.48               | 100.00         | 0.00           | 13.48        | ≤23.98      | PASS    |
| 11AC80S ISO | Ant1    | 5210            | ---       | 13.67               | 100.00         | 0.00           | 13.67        | ≤23.98      | PASS    |

Note: 1.The Duty Cycle Factor and cable loss are compensated in the graph.


## Test Graphs Channel Power

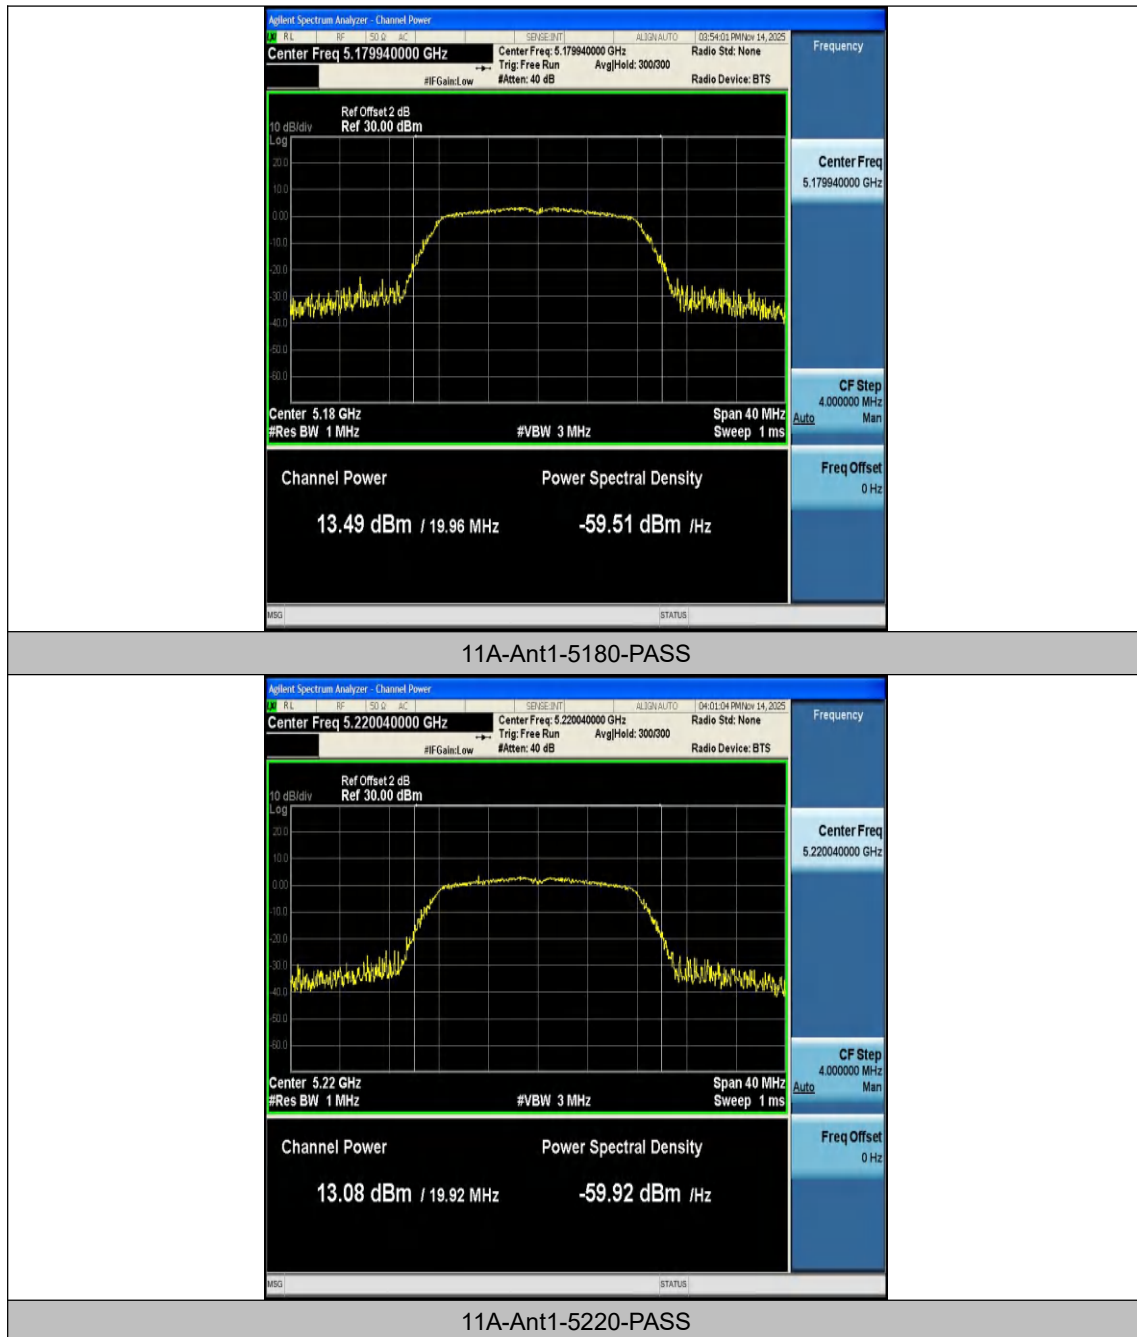

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

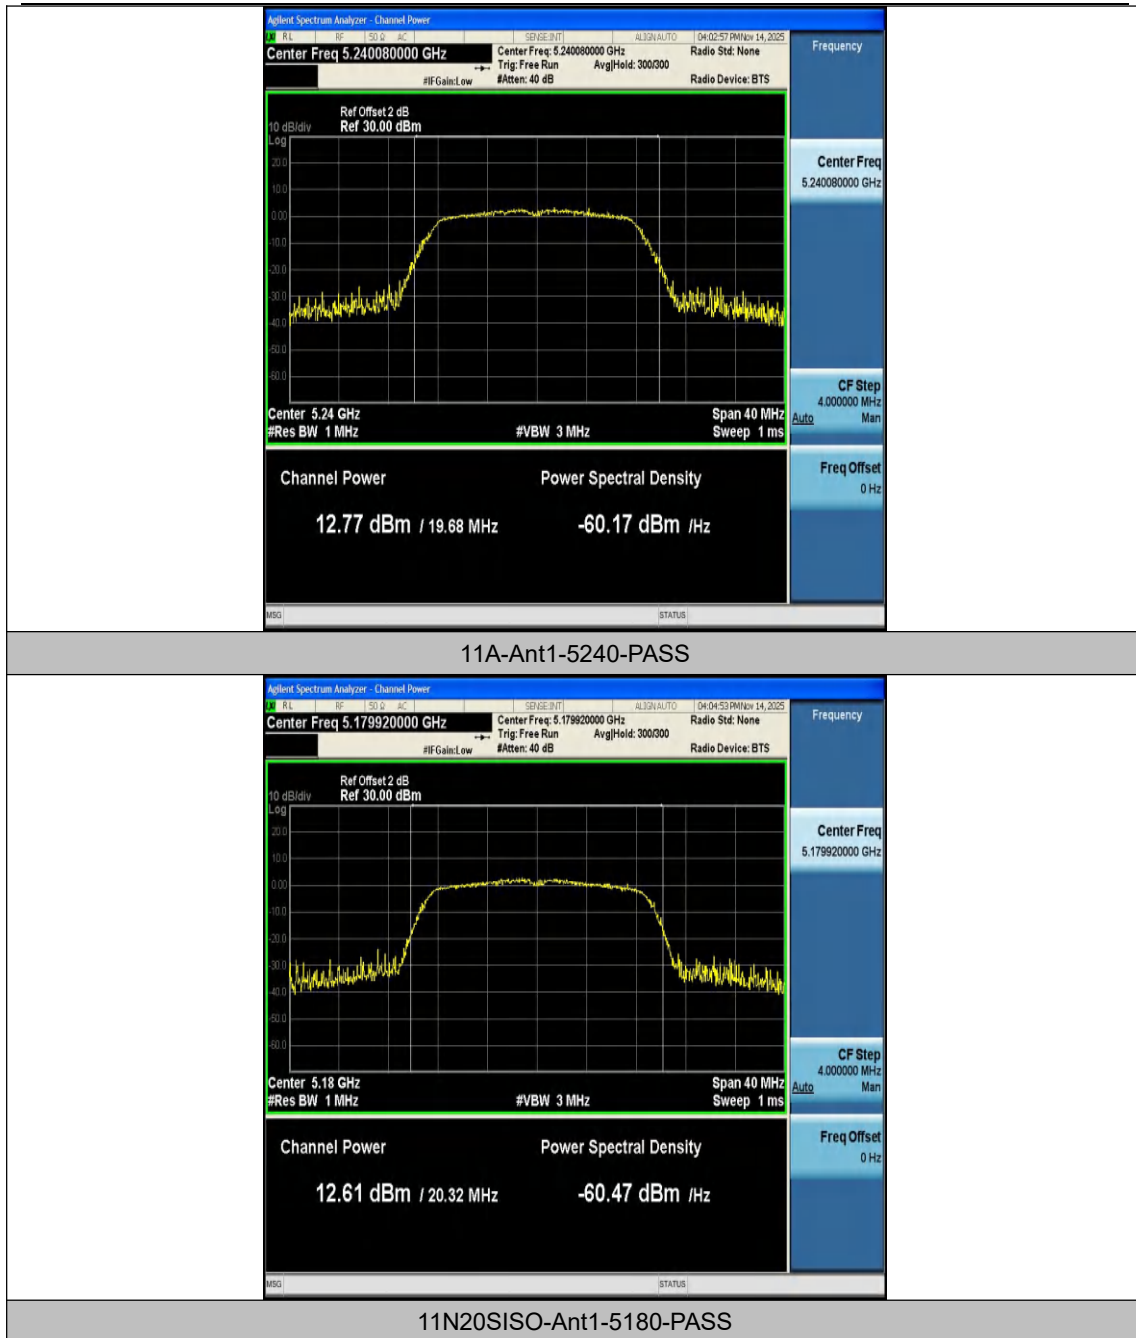

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

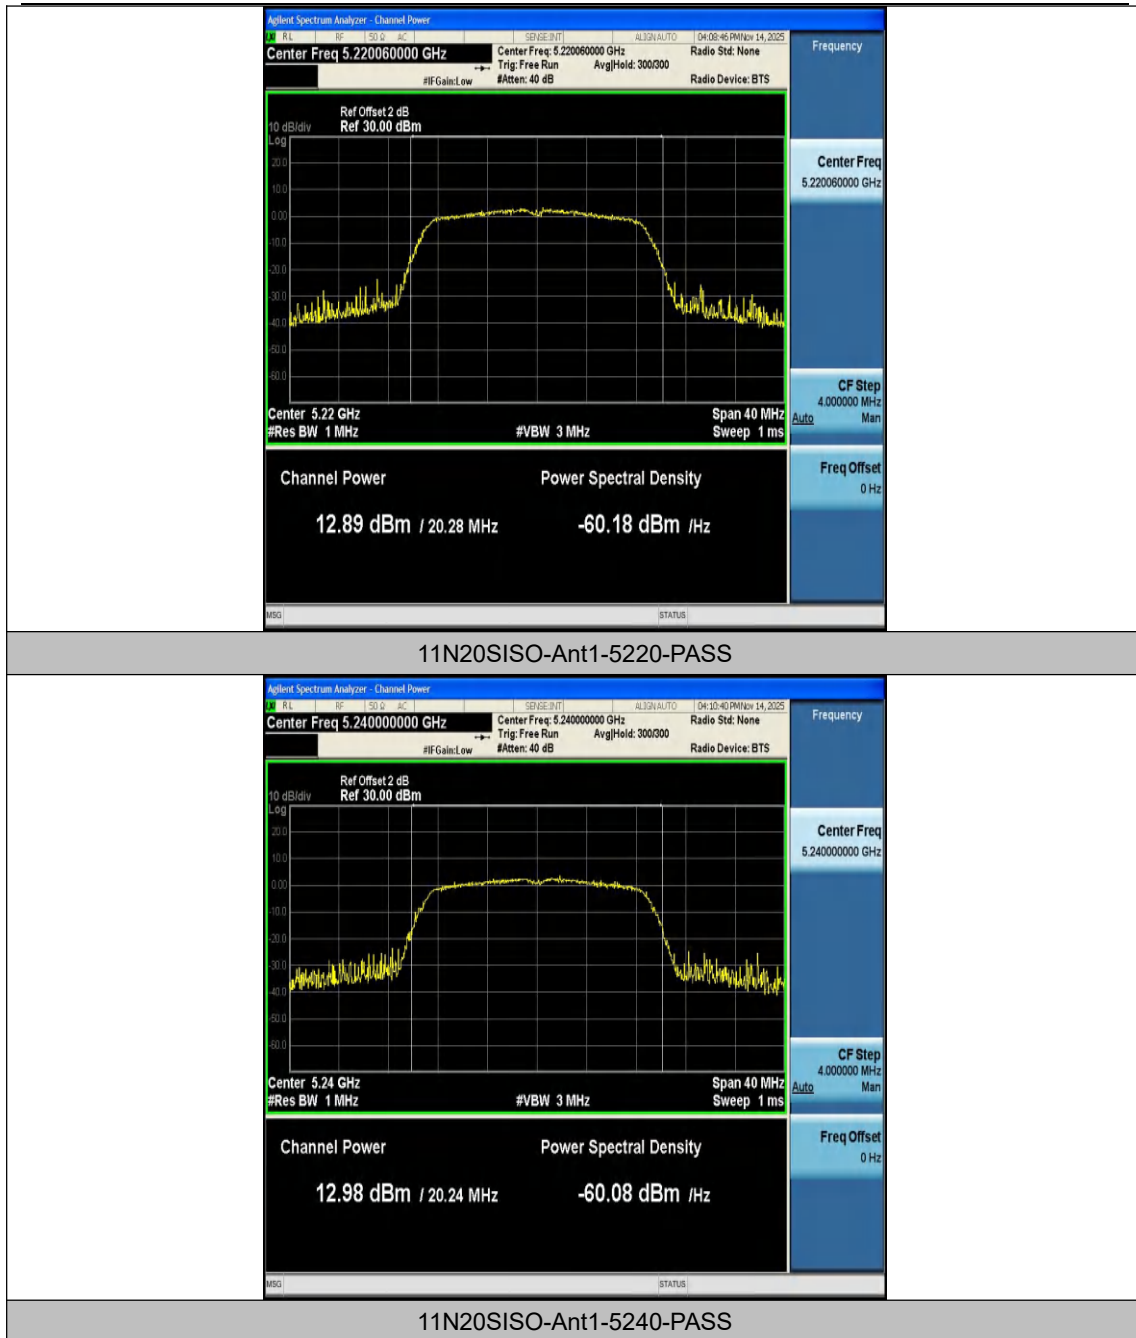

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

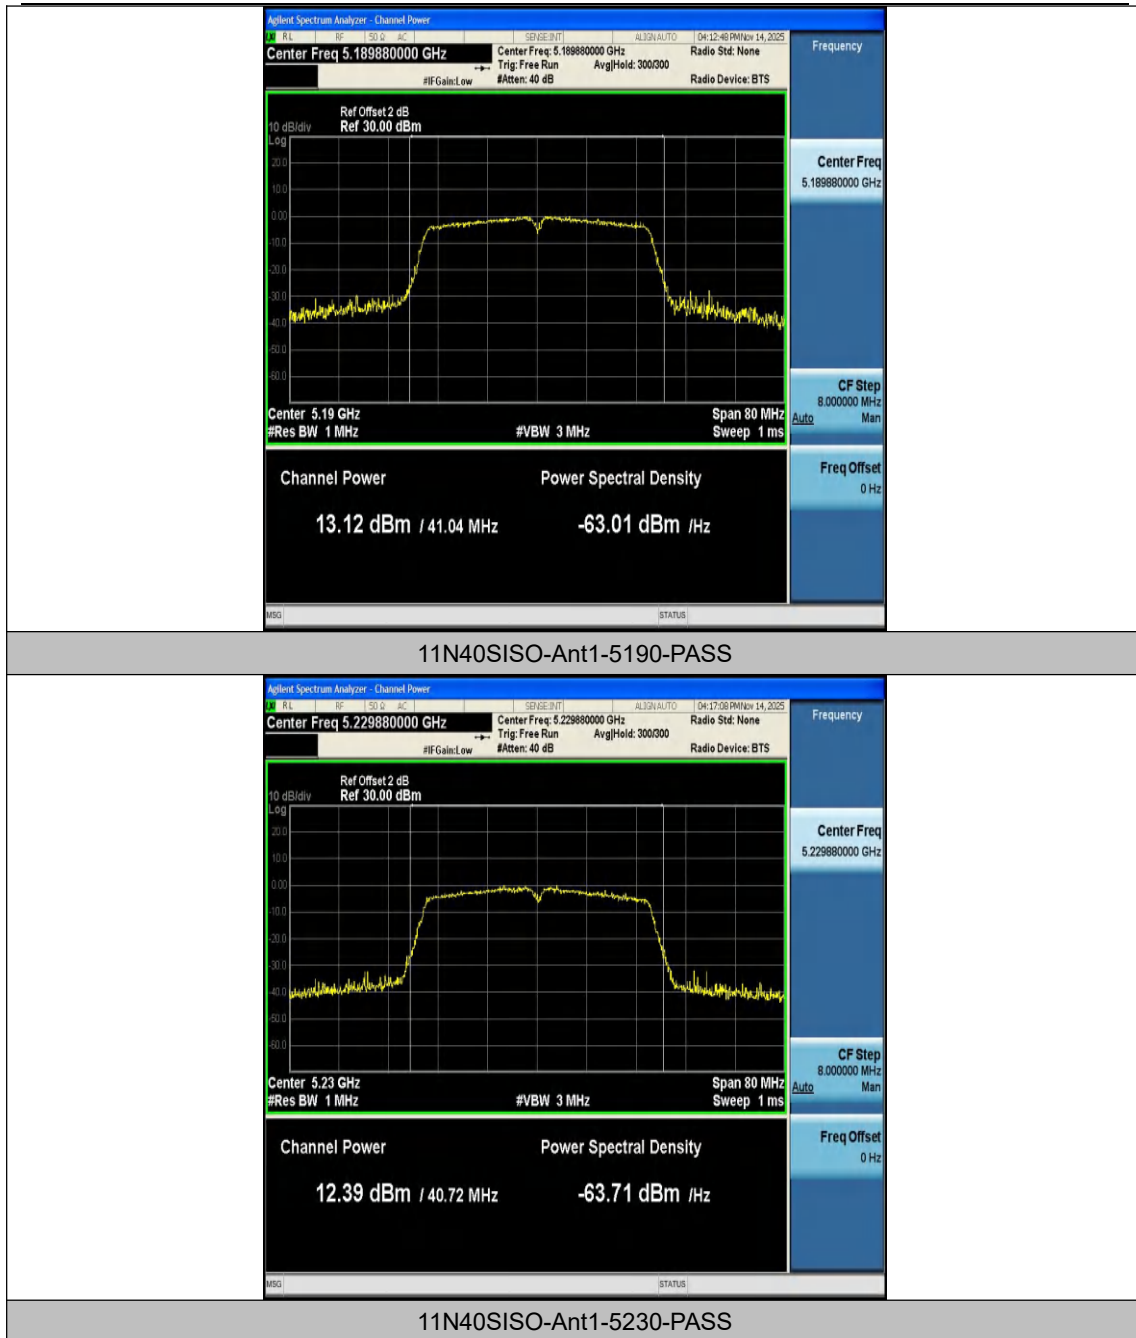

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

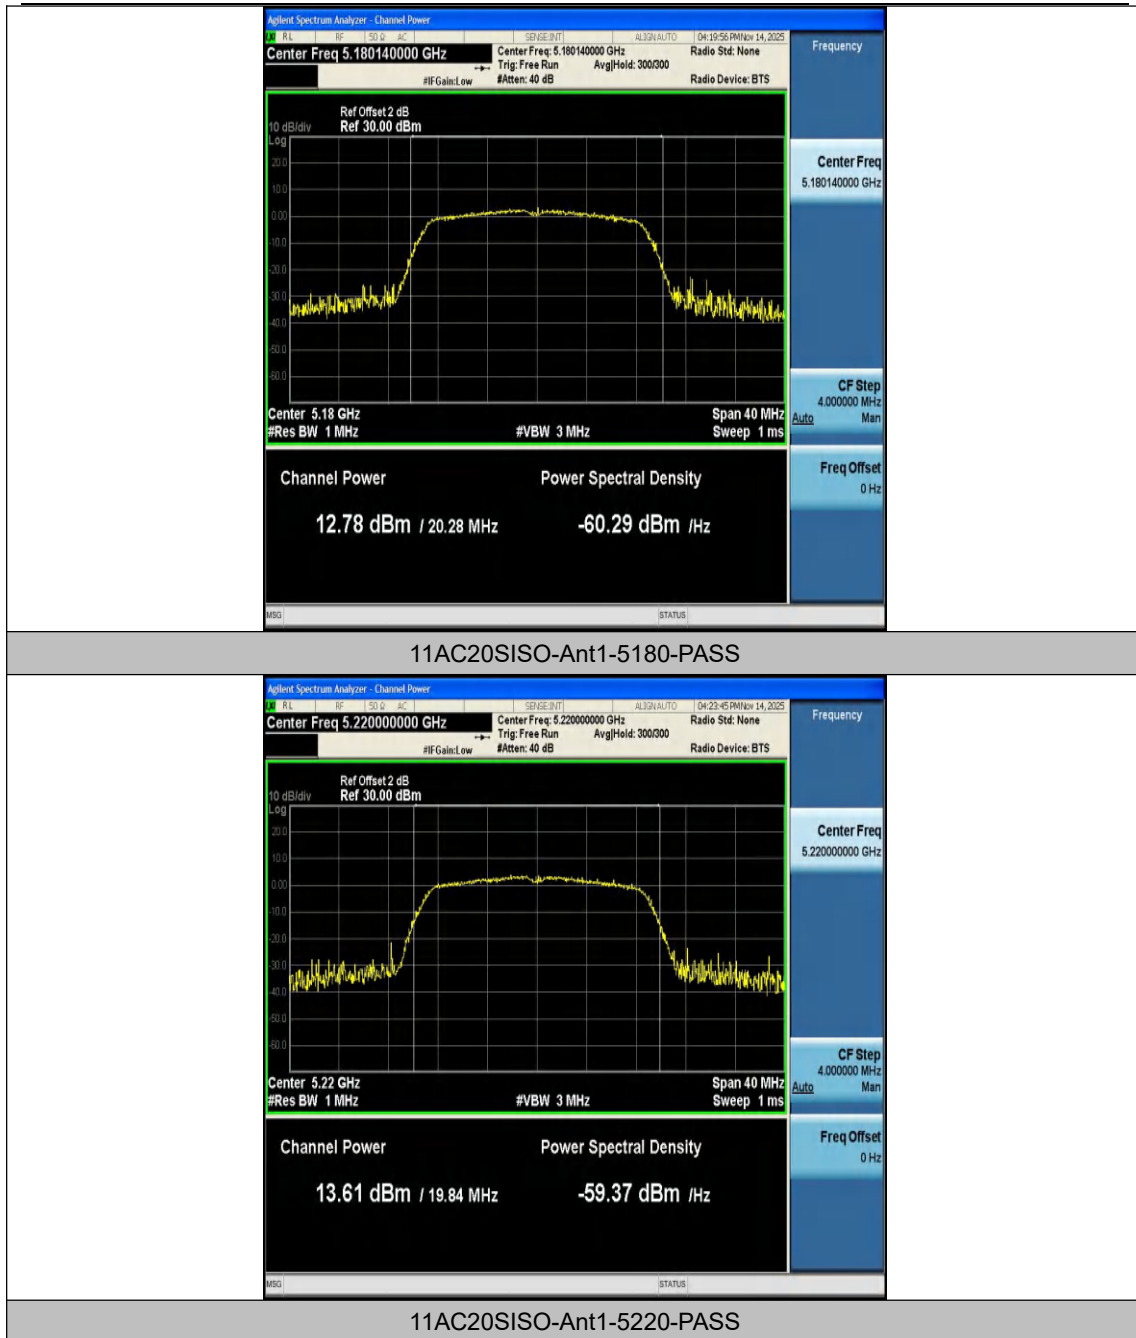

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

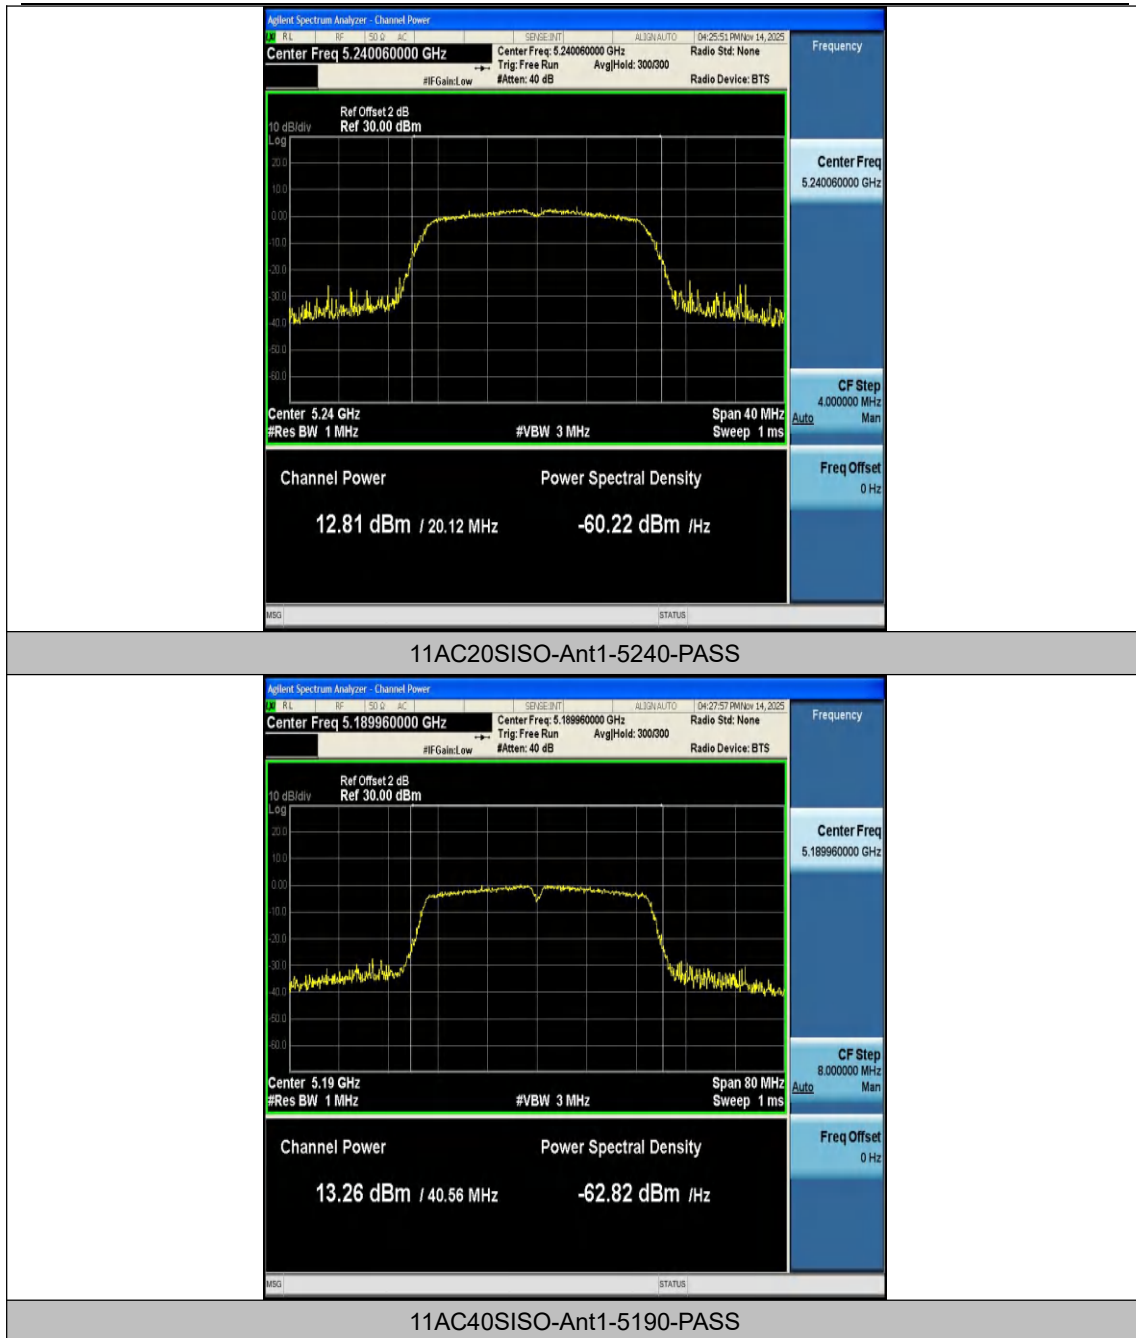

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

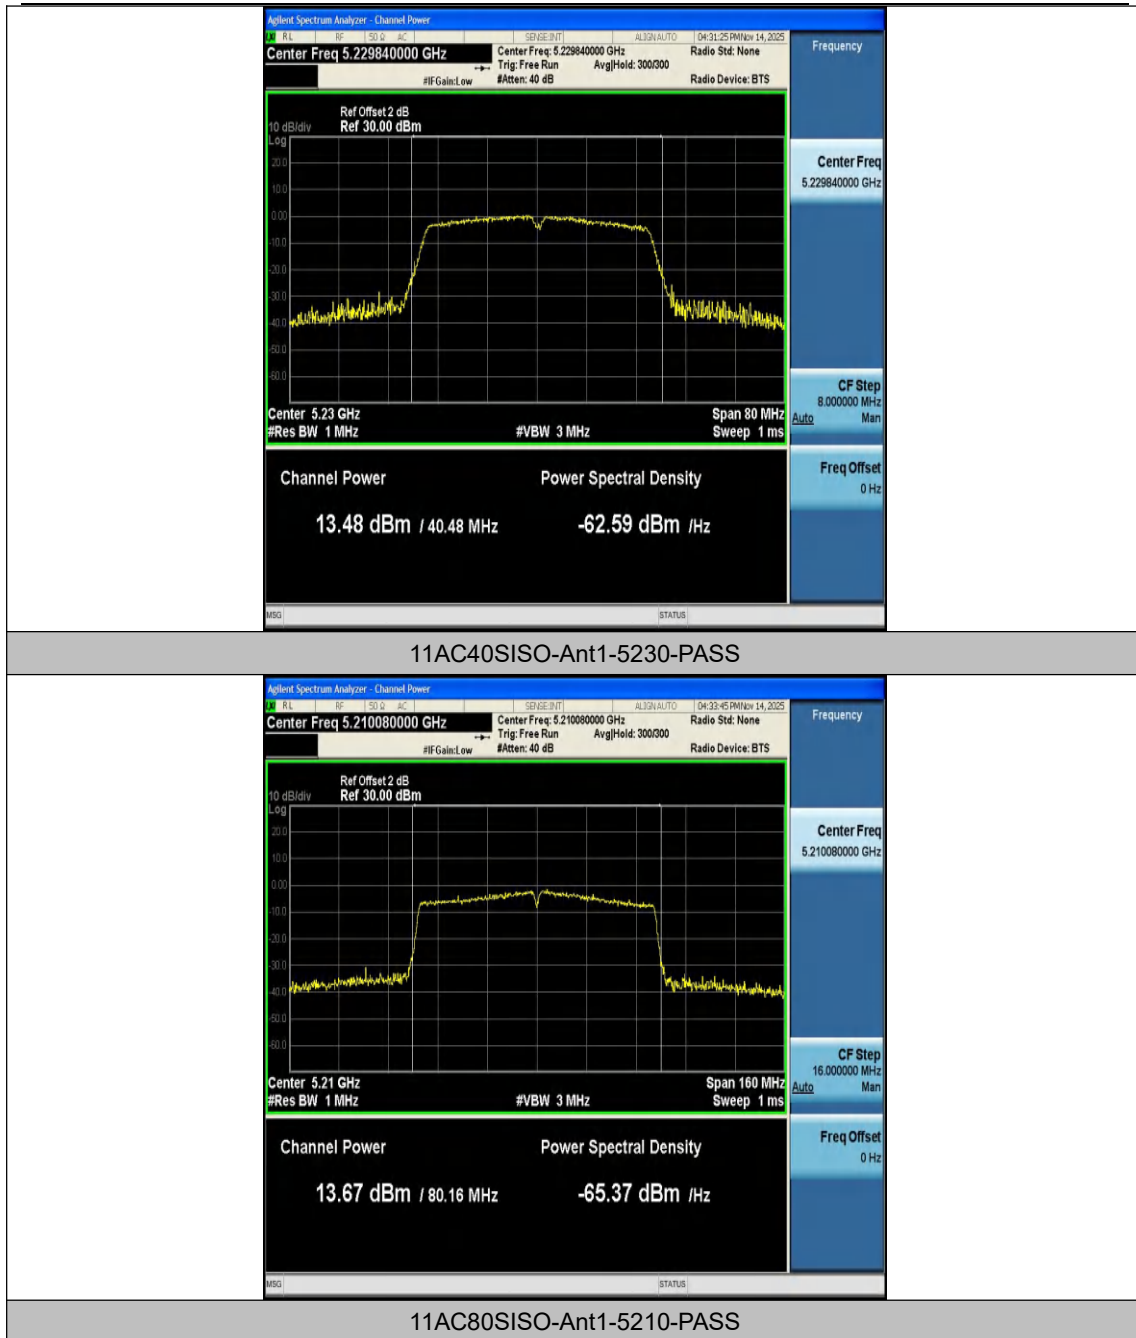

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)


## Appendix D: Maximum Power Spectral Density

### Test Result B1

| Test Mode      | Antenna | Frequency[MHz] | Reading Result[dBm /MHz] | DC Factor [dBm] | Result [dBm] | Limit [dBm/MHz] | Verdict |
|----------------|---------|----------------|--------------------------|-----------------|--------------|-----------------|---------|
| 11A            | Ant1    | 5180           | -1.64                    | 0.00            | -1.64        | ≤11.00          | PASS    |
| 11A            | Ant1    | 5220           | -1.87                    | 0.00            | -1.87        | ≤11.00          | PASS    |
| 11A            | Ant1    | 5240           | -2.29                    | 0.00            | -2.29        | ≤11.00          | PASS    |
| 11N20SI<br>SO  | Ant1    | 5180           | -2.69                    | 0.00            | -2.69        | ≤11.00          | PASS    |
| 11N20SI<br>SO  | Ant1    | 5220           | -2.36                    | 0.00            | -2.36        | ≤11.00          | PASS    |
| 11N20SI<br>SO  | Ant1    | 5240           | -2.29                    | 0.00            | -2.29        | ≤11.00          | PASS    |
| 11N40SI<br>SO  | Ant1    | 5190           | -5.20                    | 0.00            | -5.20        | ≤11.00          | PASS    |
| 11N40SI<br>SO  | Ant1    | 5230           | -5.69                    | 0.00            | -5.69        | ≤11.00          | PASS    |
| 11AC20S<br>ISO | Ant1    | 5180           | -2.53                    | 0.00            | -2.53        | ≤11.00          | PASS    |
| 11AC20S<br>ISO | Ant1    | 5220           | -1.60                    | 0.00            | -1.60        | ≤11.00          | PASS    |
| 11AC20S<br>ISO | Ant1    | 5240           | -2.47                    | 0.00            | -2.47        | ≤11.00          | PASS    |
| 11AC40S<br>ISO | Ant1    | 5190           | -4.99                    | 0.00            | -4.99        | ≤11.00          | PASS    |
| 11AC40S<br>ISO | Ant1    | 5230           | -4.65                    | 0.00            | -4.65        | ≤11.00          | PASS    |
| 11AC80S<br>ISO | Ant1    | 5210           | -7.30                    | 0.00            | -7.30        | ≤11.00          | PASS    |

Note: 1.The Duty Cycle Factor and cable loss are compensated in the graph.


## Test Graphs B1

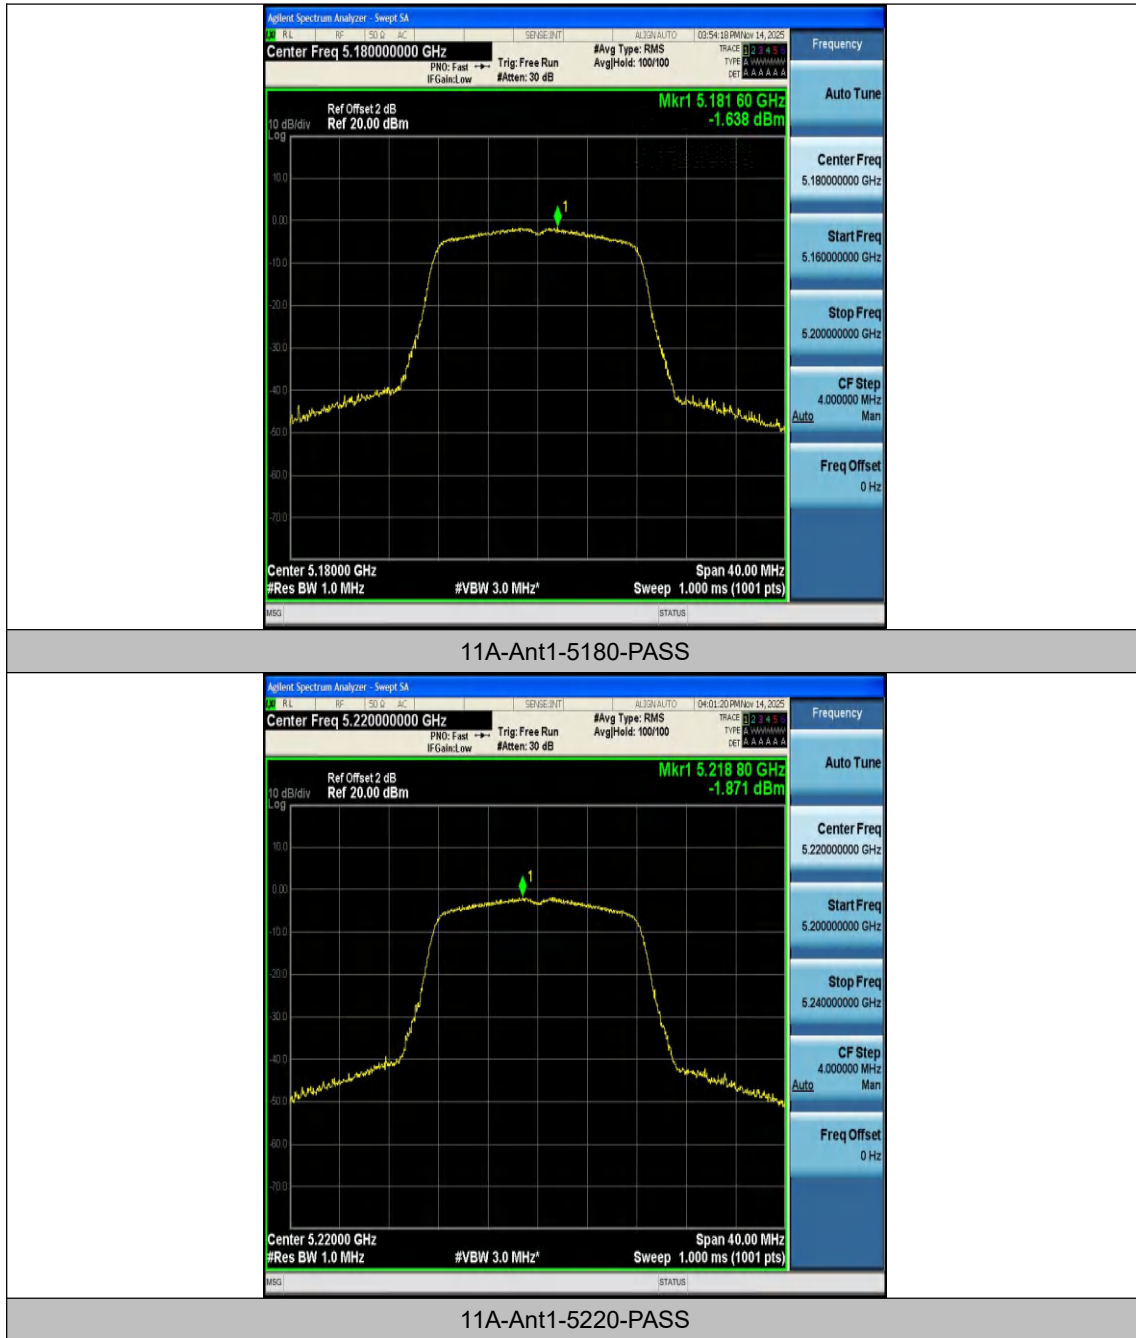

## Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

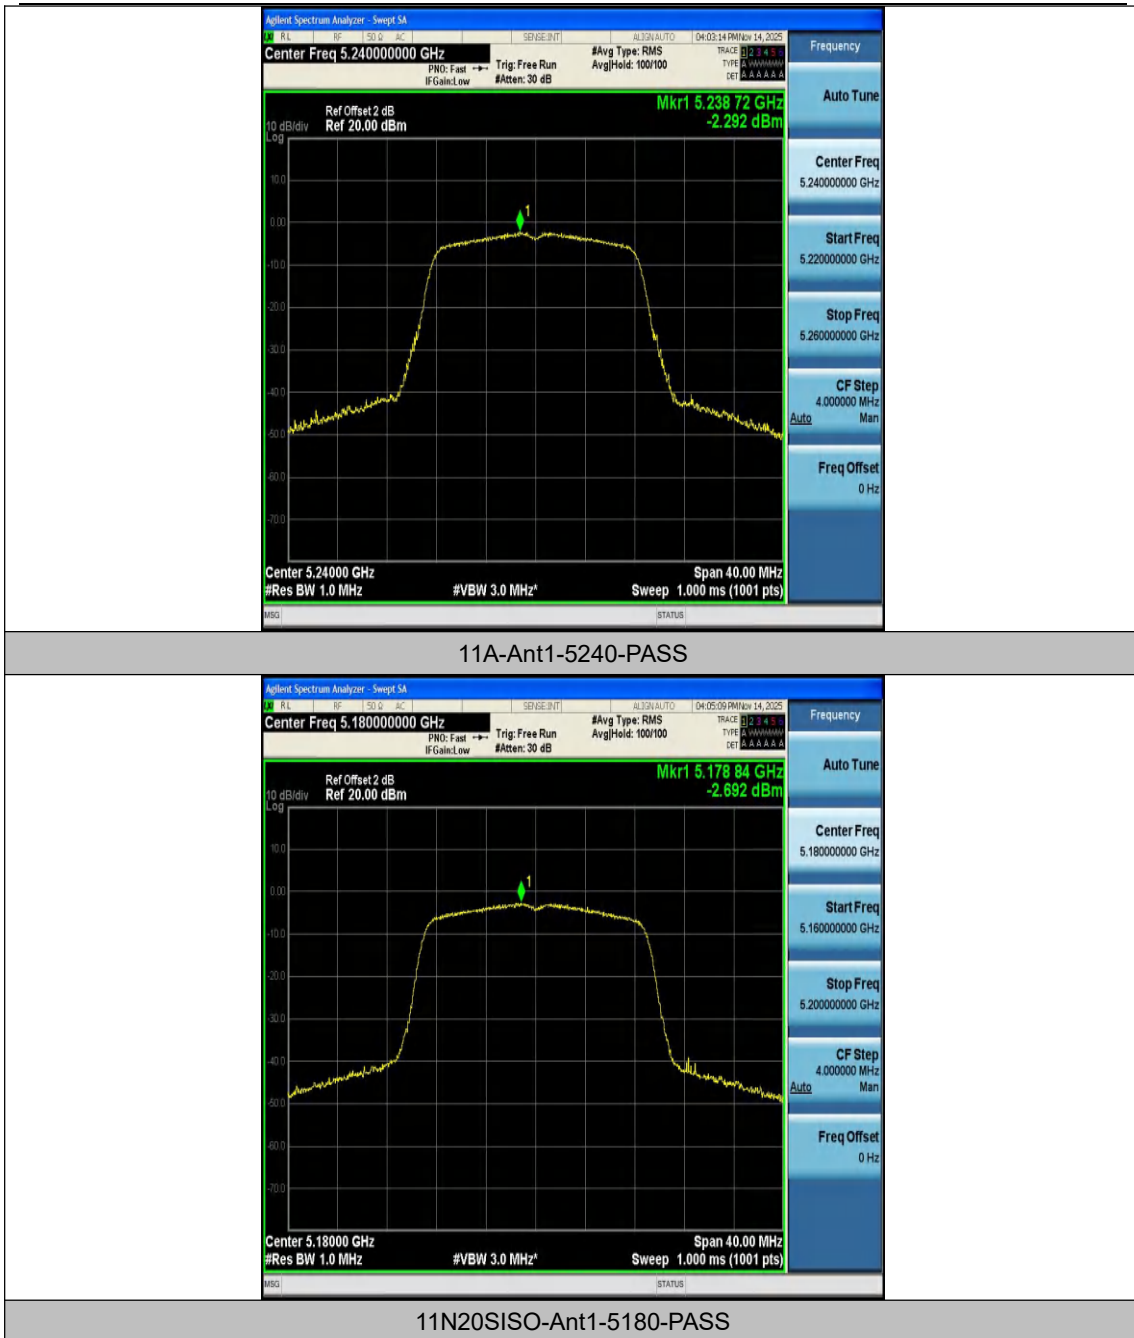

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

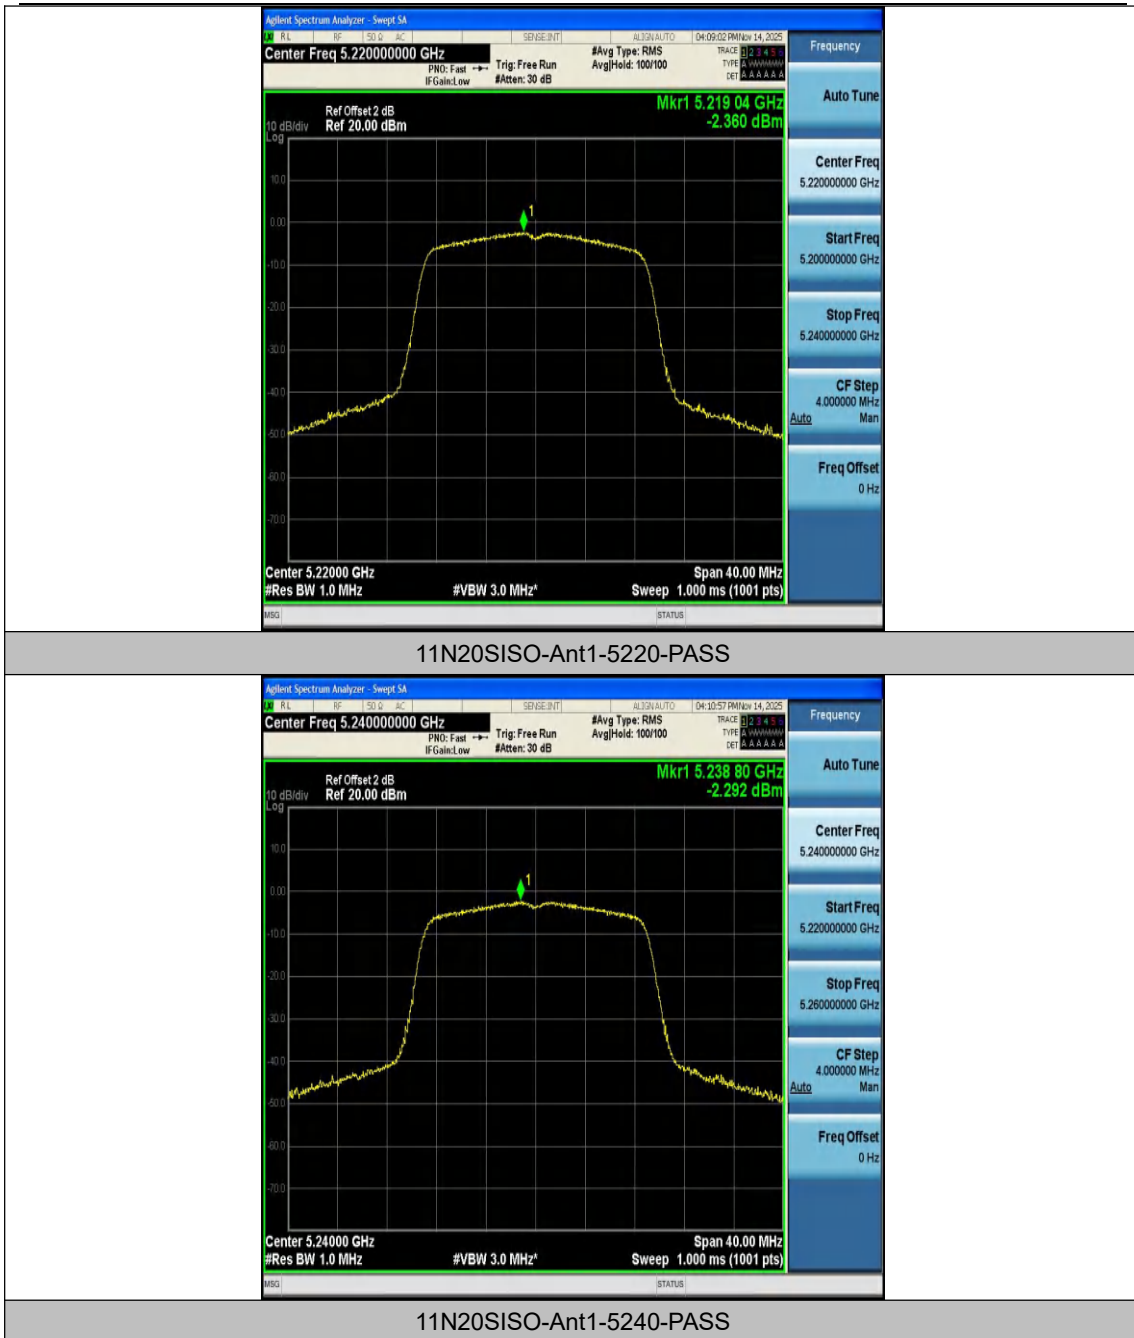

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

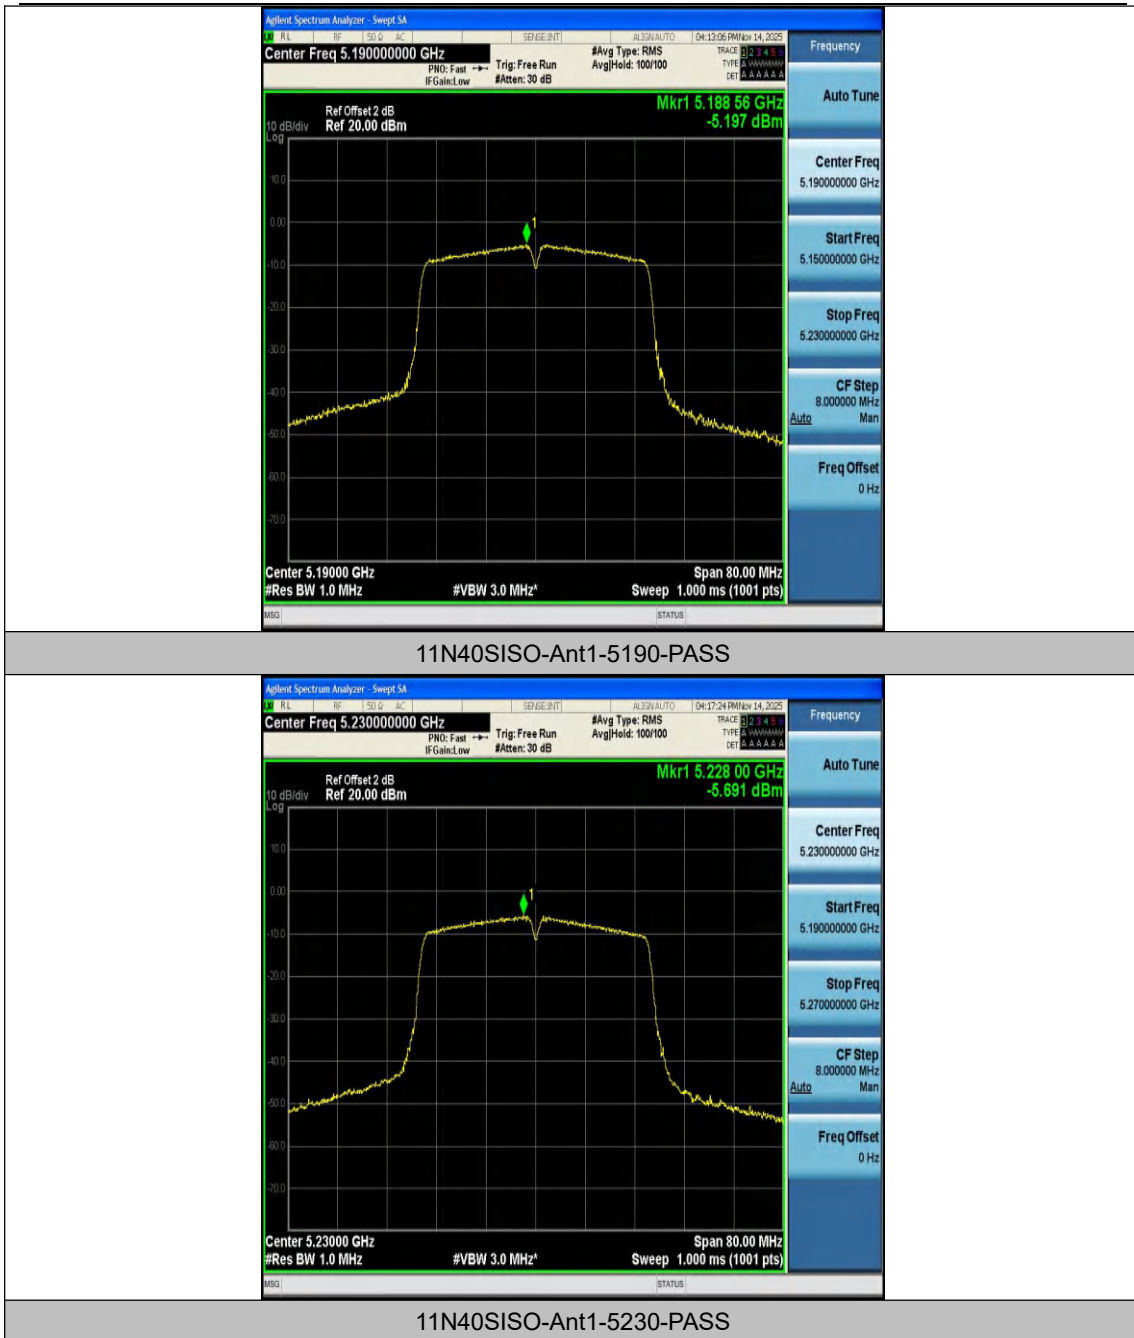

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

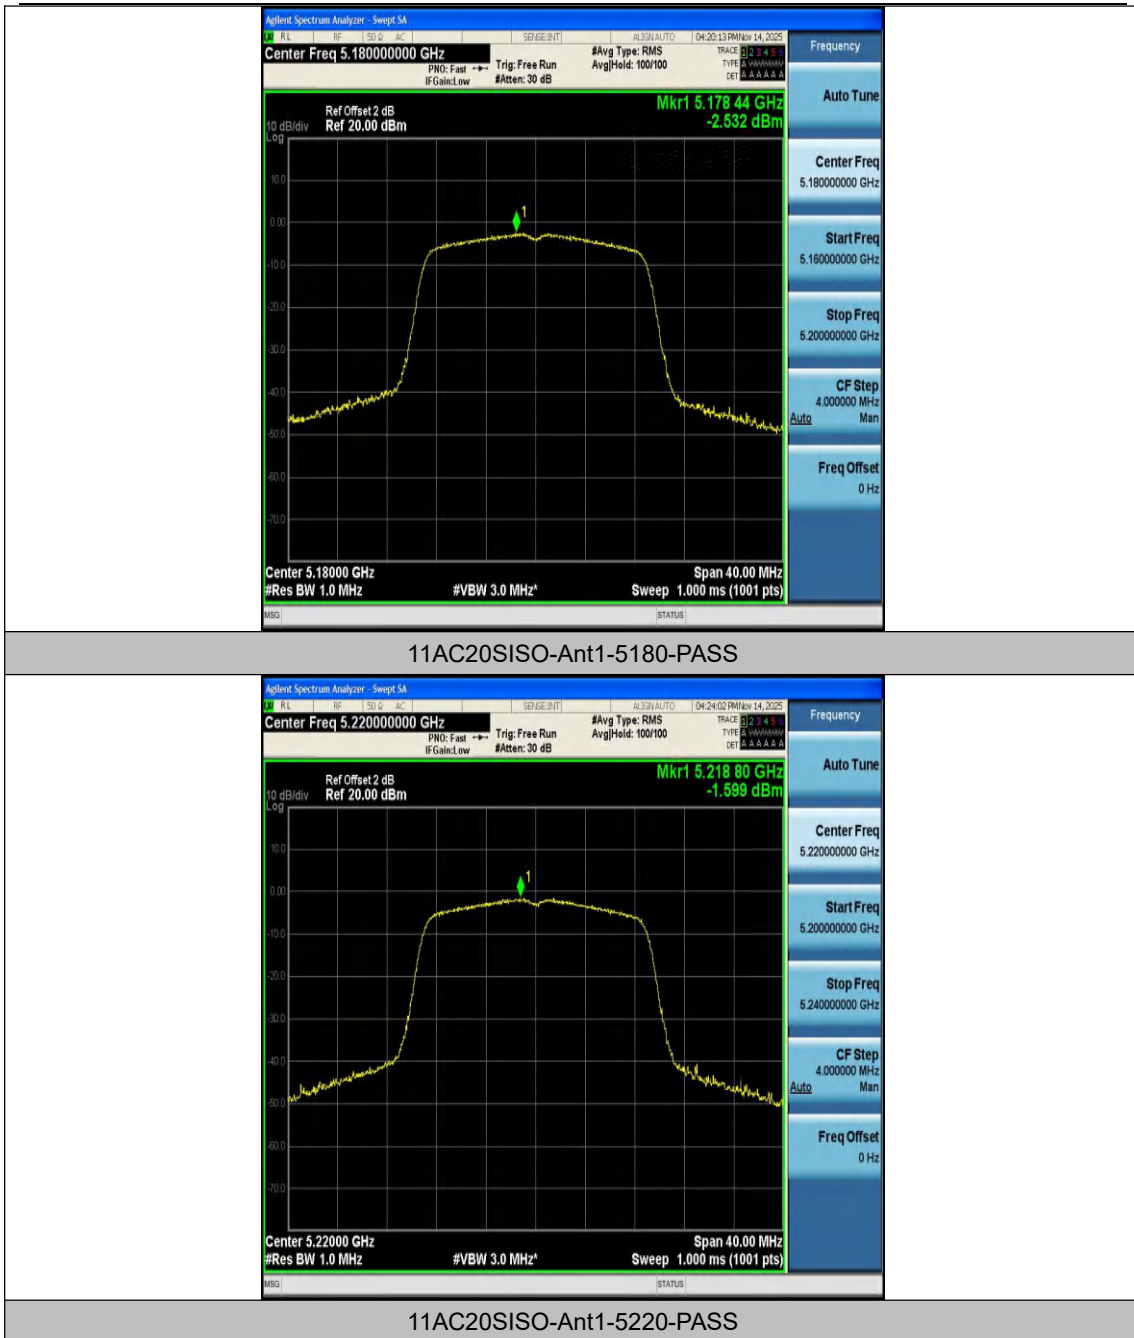

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

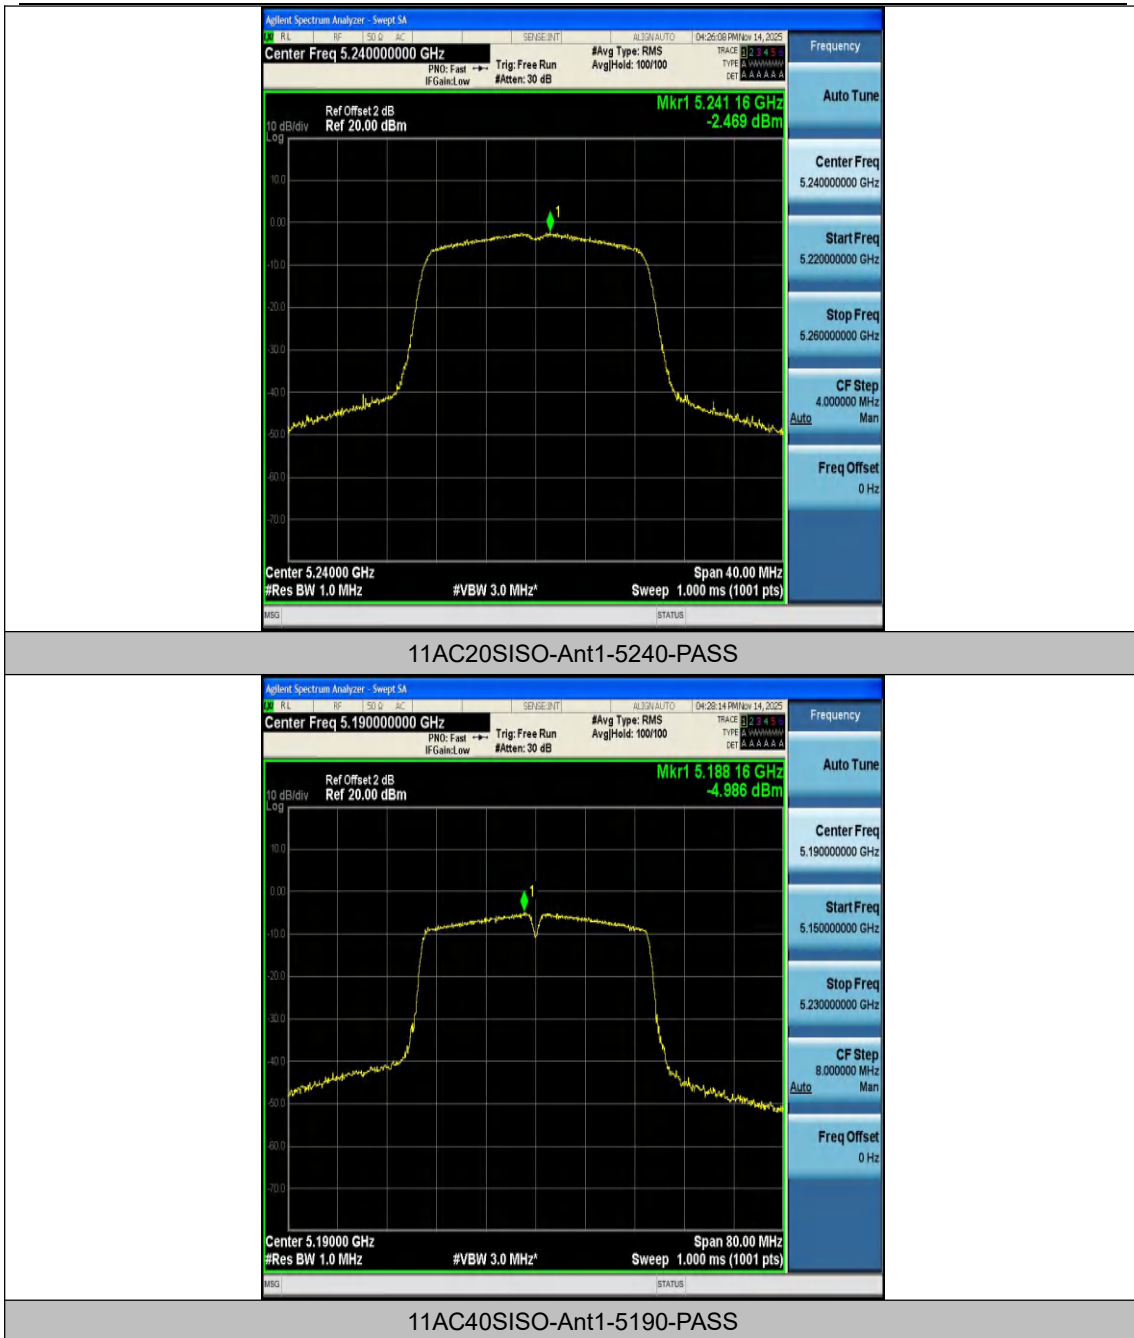

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

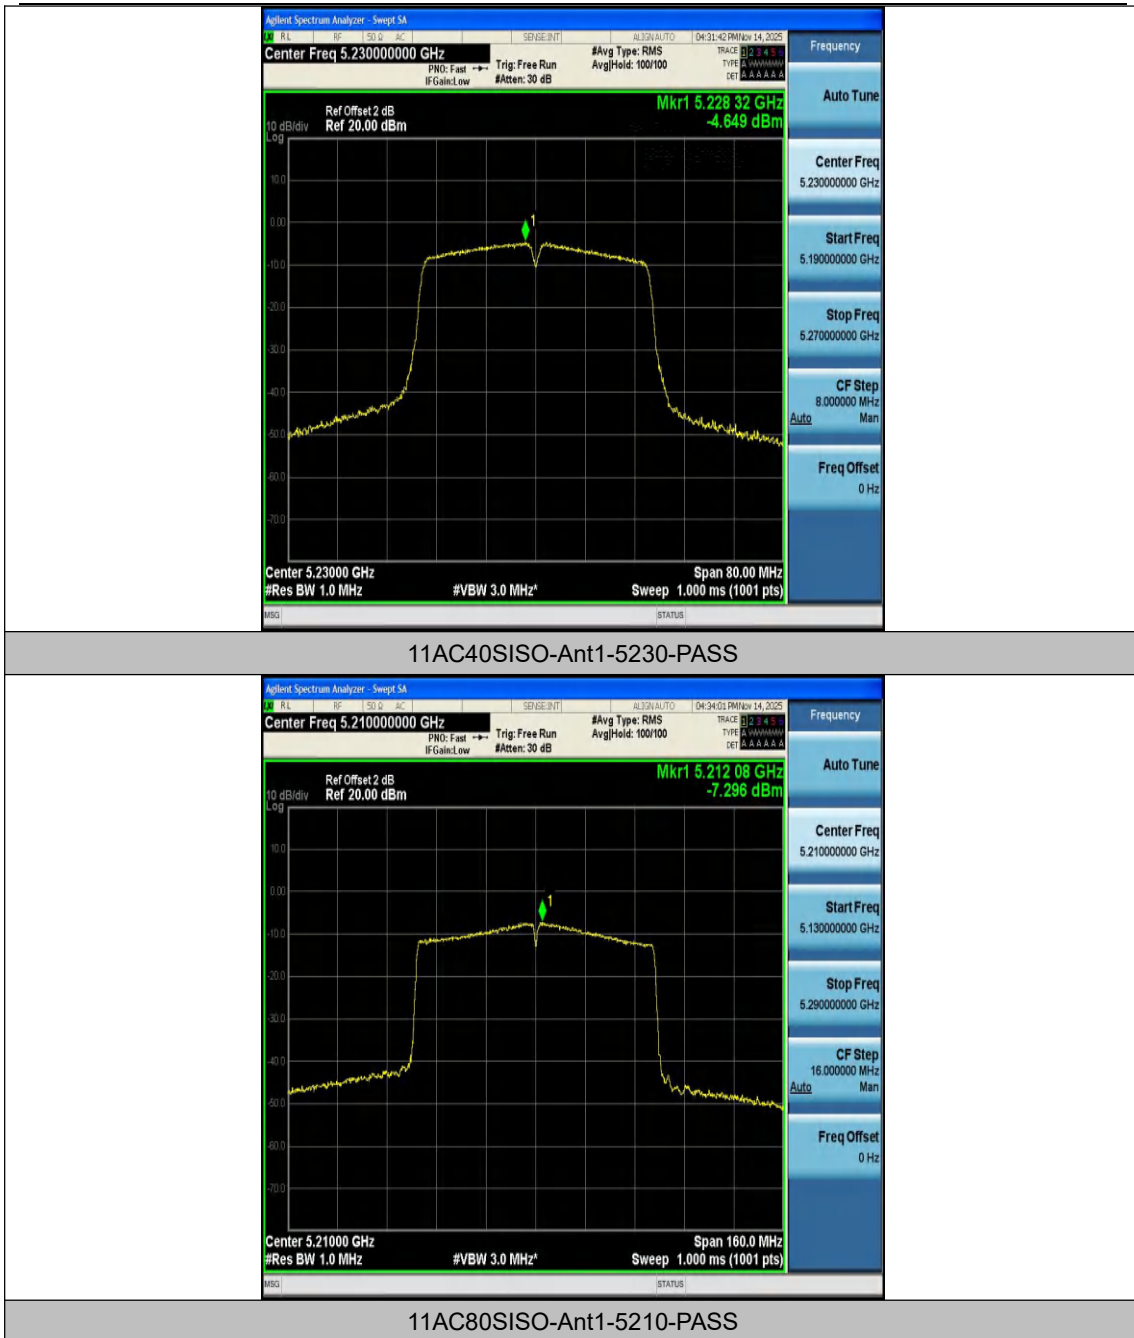

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

## Appendix E: Band edge measurements

### Test Result B1


| Test Mode  | Antenna | ChName | Frequency[MHz] | Result[dBm] | Limit[dBm] | Verdict |
|------------|---------|--------|----------------|-------------|------------|---------|
| 11A        | Ant1    | Low    | 5180           | -34.3       | ≤-27       | PASS    |
| 11N20SISO  | Ant1    | Low    | 5180           | -35.98      | ≤-27       | PASS    |
| 11N40SISO  | Ant1    | Low    | 5190           | -36.06      | ≤-27       | PASS    |
| 11AC20SISO | Ant1    | Low    | 5180           | -32.03      | ≤-27       | PASS    |
| 11AC40SISO | Ant1    | Low    | 5190           | -36.17      | ≤-27       | PASS    |
| 11AC80SISO | Ant1    | Low    | 5210           | -32.96      | ≤-27       | PASS    |

Note: The margin plus the antenna gain also meets the limit.

Remark:Regarding the spurious emissions from 30MHz to 26.5GHz, the cable lose have been set in the 'offset' of the Spectrum Analyzer during the test.

### Test Graphs B1




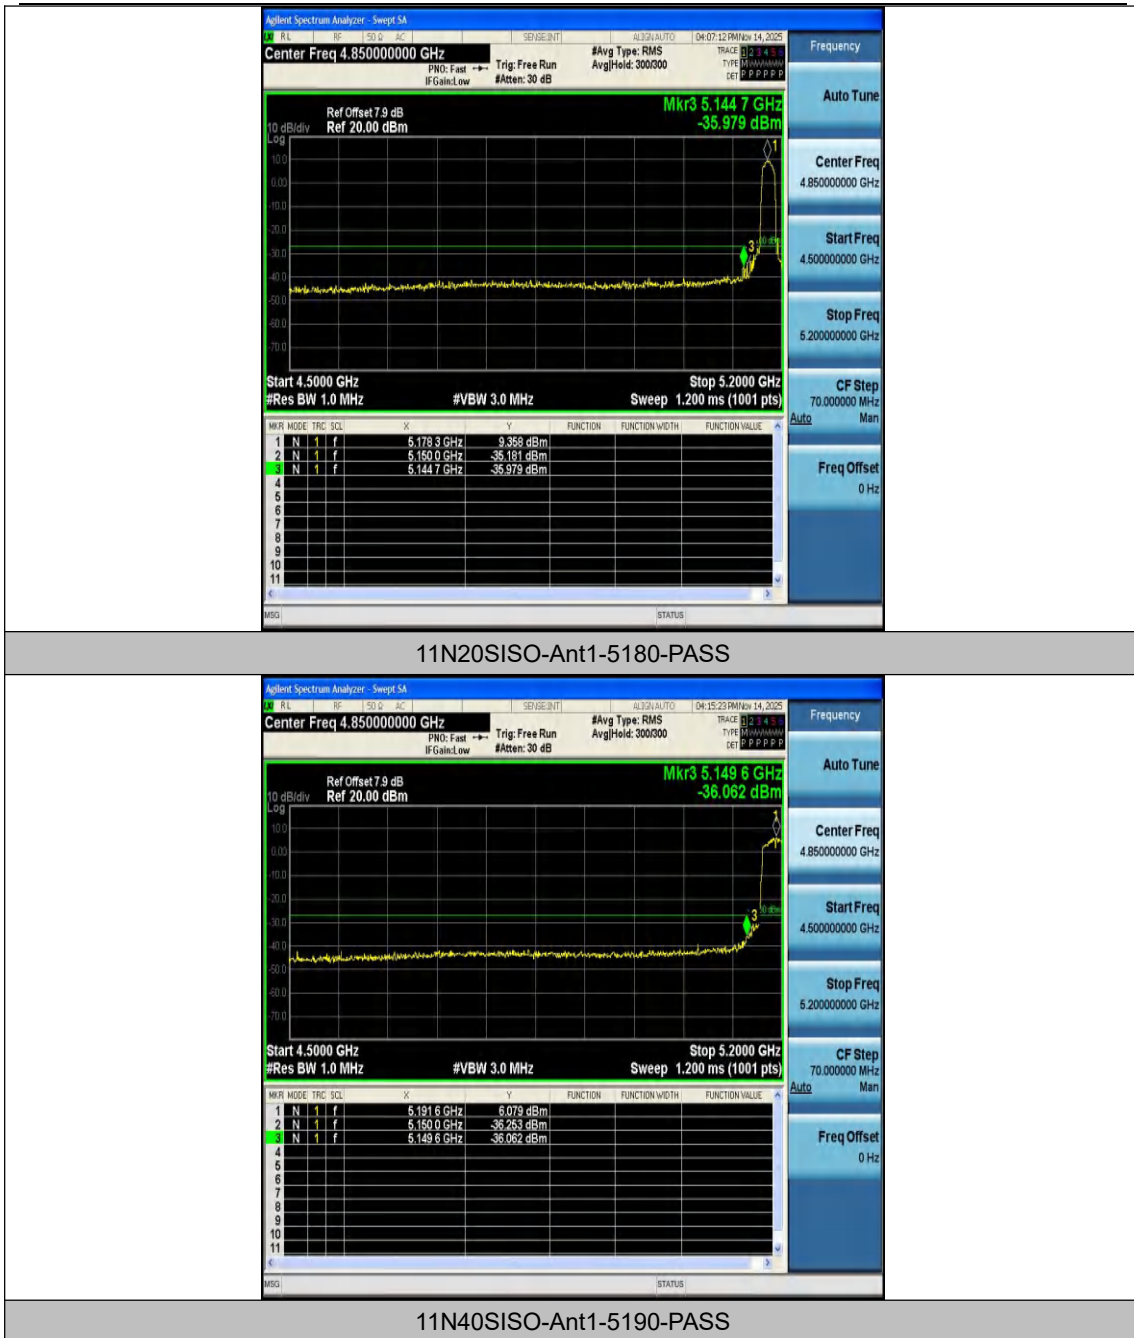


#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

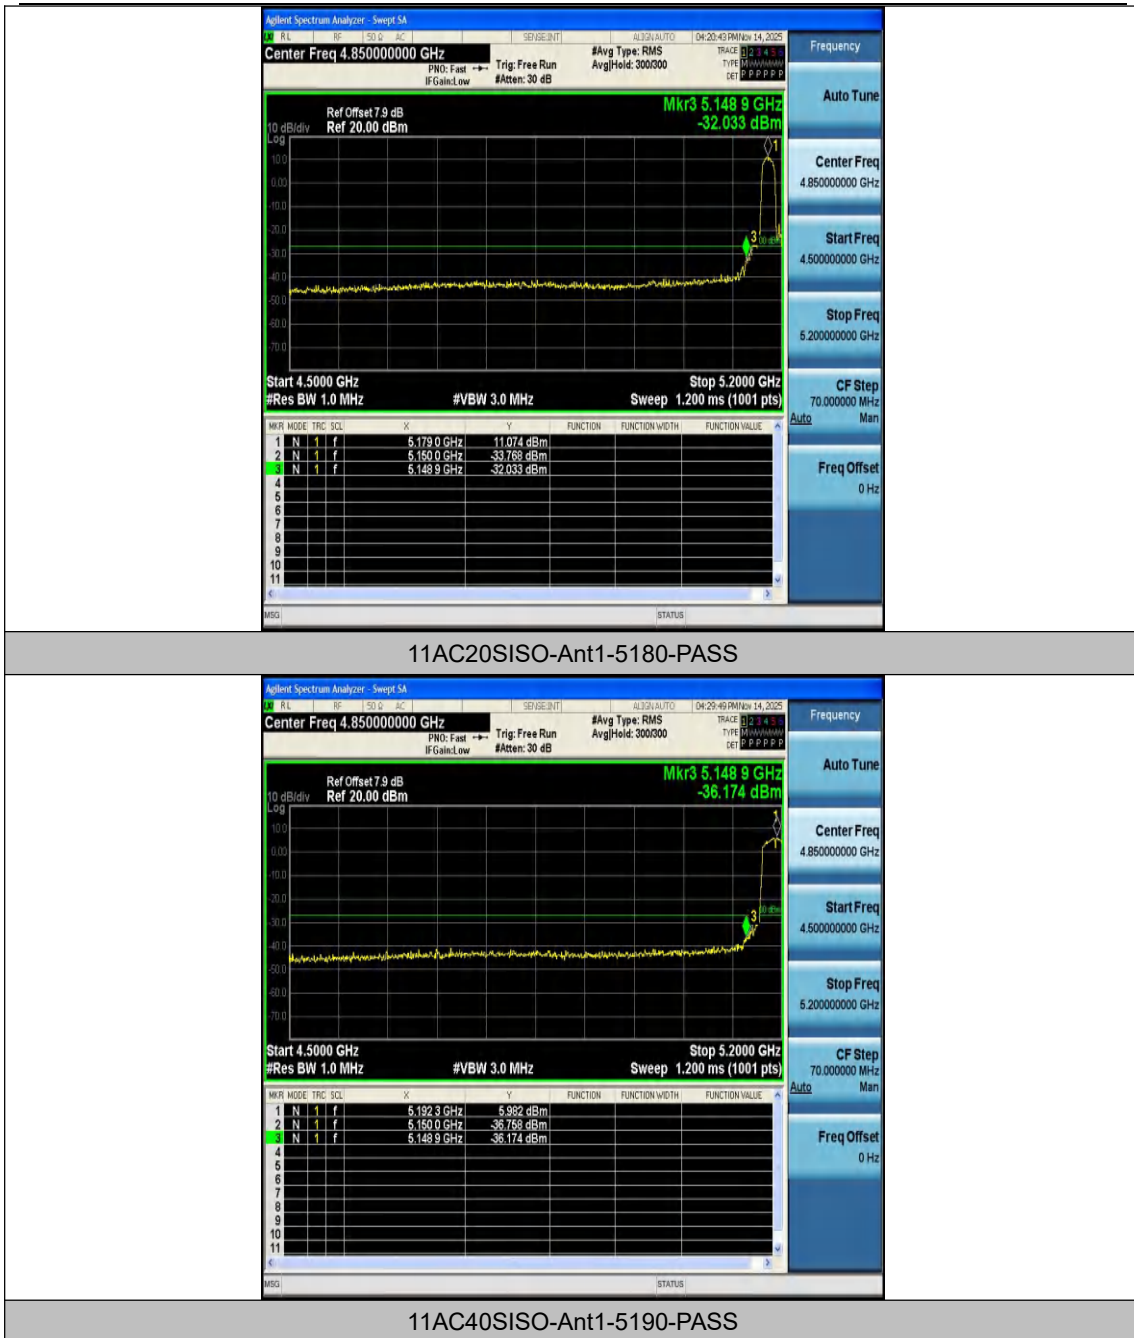

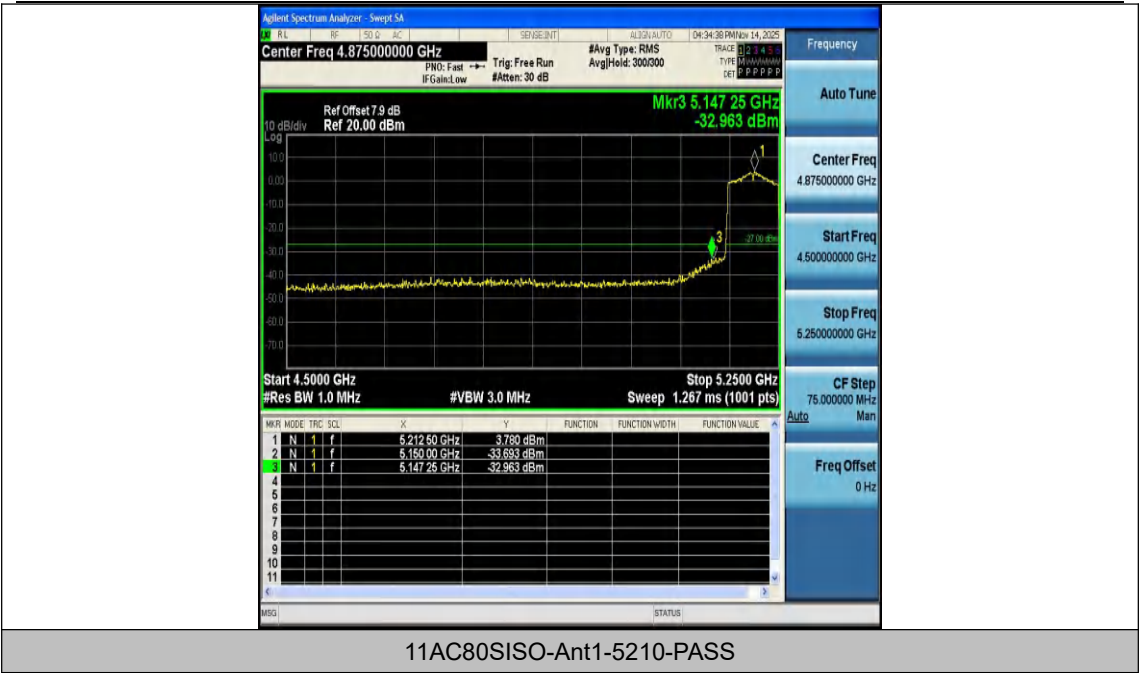

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com