

10.5APPENDIXF: NUMBER OF HOPPING CHANNELS**Test Result**

TestMode	Antenna	Channel	Result[Num]	Limit[Num]	Verdict
DH1	Ant1	Hop	79	>=15	PASS
2DH1	Ant1	Hop	79	>=15	PASS
3DH1	Ant1	Hop	79	>=15	PASS

Test Graphs




10.6 APPENDIX: BAND EDGE MEASUREMENTS

Test Result

TestMode	Antenna	ChName	Channel	RefLevel [dBm]	Result [dBm]	Limit [dBm]	Verdict
DH1	Ant1	Low	2402	1.28	-56.19	<=-18.72	PASS
		High	2480	1.18	-55.41	<=-18.82	PASS
		Low	Hop_2402	1.29	-56.25	-18.71	PASS
		High	Hop_2480	1.35	-56.09	-18.65	PASS
2DH1	Ant1	Low	2402	2.44	-55.79	<=-17.56	PASS
		High	2480	2.21	-55.5	<=-17.79	PASS
		Low	Hop_2402	2.53	-56.09	-17.47	PASS
		High	Hop_2480	2.44	-54.94	-17.56	PASS
3DH1	Ant1	Low	2402	2.44	-56.26	<=-17.56	PASS
		High	2480	2.23	-55.11	<=-17.77	PASS
		Low	Hop_2402	2.68	-56.46	-17.32	PASS
		High	Hop_2480	2.00	-55.85	-18	PASS

Test Graphs



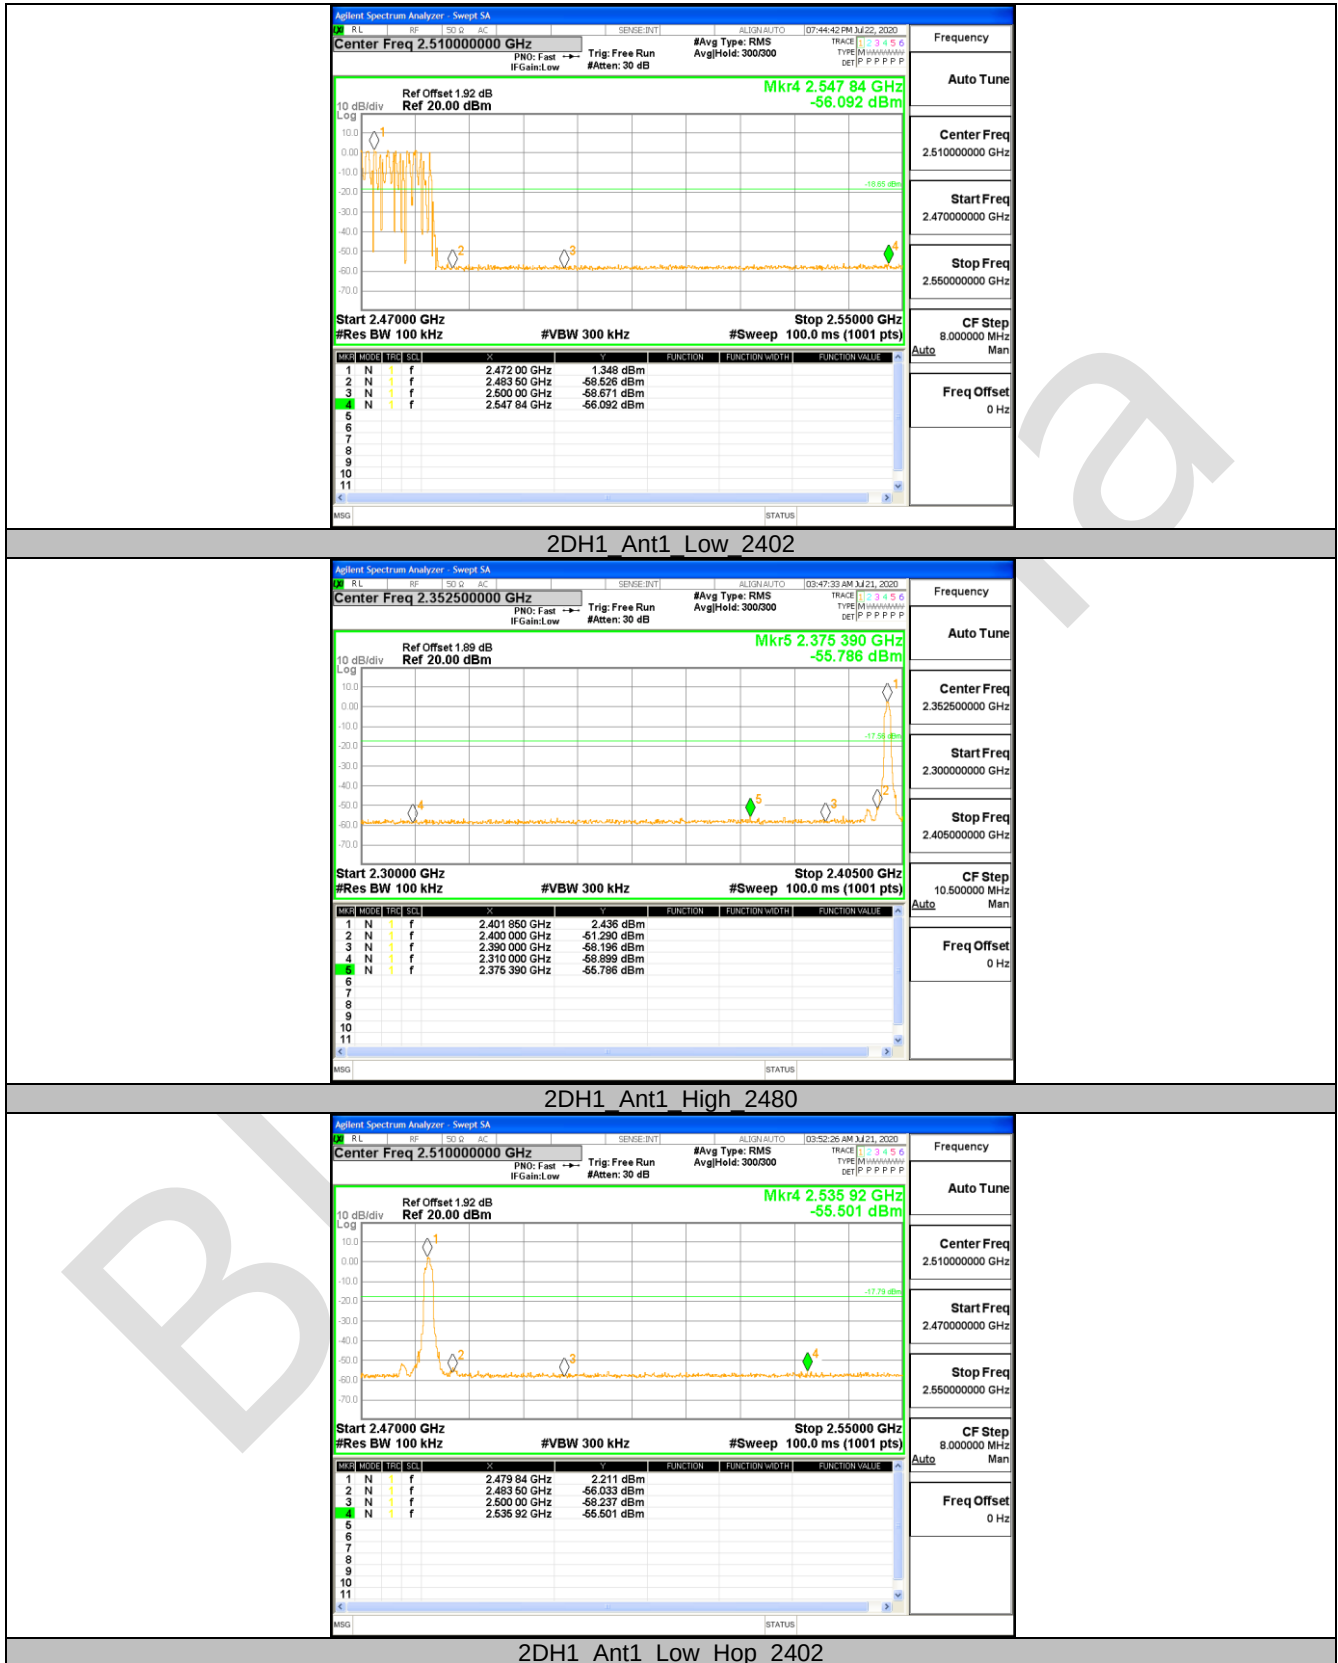





10.7 APPENDIX: CONDUCTED SPURIOUS EMISSION

Test Result

TestMode	Antenna	Channel	FreqRange [MHz]	RefLevel [dBm]	Result [dBm]	Limit [dBm]	Verdict
DH1	Ant1	2402	Reference	1.27	1.27	---	PASS
			30~1000	30~1000	-68.239	<=-18.726	PASS
			1000~26500	1000~26500	-51.858	<=-18.726	PASS
		2441	Reference	1.31	1.31	---	PASS
			30~1000	30~1000	-66.97	<=-18.688	PASS
			1000~26500	1000~26500	-53.745	<=-18.688	PASS
		2480	Reference	1.10	1.10	---	PASS
			30~1000	30~1000	-67.646	<=-18.901	PASS
			1000~26500	1000~26500	-53.587	<=-18.901	PASS
2DH1	Ant1	2402	Reference	2.43	2.43	---	PASS
			30~1000	30~1000	-66.855	<=-17.566	PASS
			1000~26500	1000~26500	-53.491	<=-17.566	PASS
		2441	Reference	2.27	2.27	---	PASS
			30~1000	30~1000	-67.175	<=-17.727	PASS
			1000~26500	1000~26500	-53.161	<=-17.727	PASS
		2480	Reference	2.16	2.16	---	PASS
			30~1000	30~1000	-67.021	<=-17.839	PASS
			1000~26500	1000~26500	-53.27	<=-17.839	PASS
3DH1	Ant1	2402	Reference	2.05	2.05	---	PASS
			30~1000	30~1000	-67.498	<=-17.954	PASS
			1000~26500	1000~26500	-53.227	<=-17.954	PASS
		2441	Reference	2.24	2.24	---	PASS
			30~1000	30~1000	-67.575	<=-17.761	PASS
			1000~26500	1000~26500	-53.429	<=-17.761	PASS
		2480	Reference	2.11	2.11	---	PASS
			30~1000	30~1000	-67.599	<=-17.891	PASS
			1000~26500	1000~26500	-52.974	<=-17.891	PASS

Test Graphs



