



## Appendix E

### RF Test Data for 5.8GWIFI(Conducted Measurement)

Product Name: Network Player

Test Model: 778S

#### Environmental Conditions

|                    |           |
|--------------------|-----------|
| Temperature:       | 24.6° C   |
| Relative Humidity: | 53.5%     |
| ATM Pressure:      | 100.0 kPa |
| Test Engineer:     | Jerry Chu |
| Supervised by:     | Can Kun   |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: [webmaster@lcs-cert.com](mailto:webmaster@lcs-cert.com) | Web: [www.lcs-cert.com](http://www.lcs-cert.com)

Scan code to check authenticity



## E.1 -6dB Bandwidth

| Condition | Mode | Frequency (MHz) | Antenna | -6 dB Bandwidth (MHz) | Limit -6 dB Bandwidth (MHz) | Verdict |
|-----------|------|-----------------|---------|-----------------------|-----------------------------|---------|
| NVNT      | a    | 5745            | Ant1    | 16.34                 | 0.5                         | Pass    |
| NVNT      | a    | 5785            | Ant1    | 16.37                 | 0.5                         | Pass    |
| NVNT      | a    | 5825            | Ant1    | 16.35                 | 0.5                         | Pass    |
| NVNT      | n20  | 5745            | Ant1    | 17.38                 | 0.5                         | Pass    |
| NVNT      | n20  | 5785            | Ant1    | 17.54                 | 0.5                         | Pass    |
| NVNT      | n20  | 5825            | Ant1    | 17.42                 | 0.5                         | Pass    |
| NVNT      | n40  | 5755            | Ant1    | 36.4                  | 0.5                         | Pass    |
| NVNT      | n40  | 5795            | Ant1    | 36.18                 | 0.5                         | Pass    |
| NVNT      | ac20 | 5745            | Ant1    | 17.43                 | 0.5                         | Pass    |
| NVNT      | ac20 | 5785            | Ant1    | 17.52                 | 0.5                         | Pass    |
| NVNT      | ac20 | 5825            | Ant1    | 17.41                 | 0.5                         | Pass    |
| NVNT      | ac40 | 5755            | Ant1    | 36.29                 | 0.5                         | Pass    |
| NVNT      | ac40 | 5795            | Ant1    | 36.16                 | 0.5                         | Pass    |
| NVNT      | ac80 | 5775            | Ant1    | 75.24                 | 0.5                         | Pass    |




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

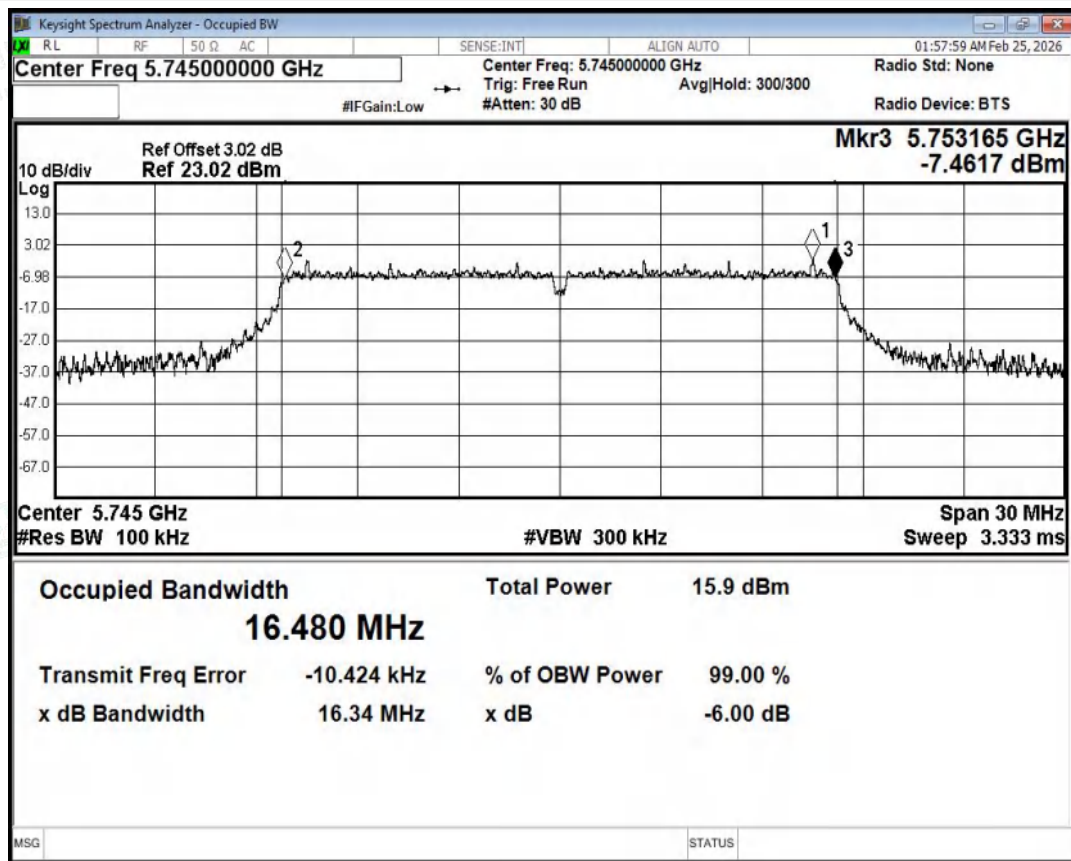

-6dB Bandwidth NVNT a 5745MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

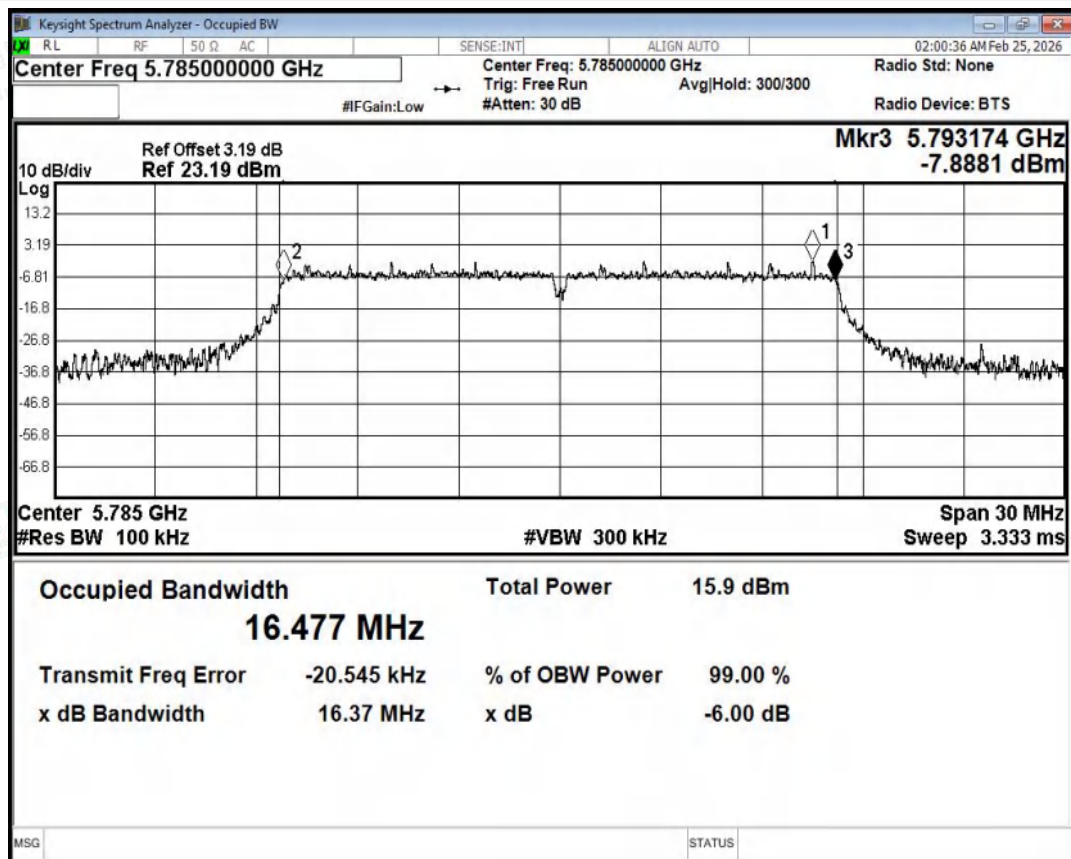

-6dB Bandwidth NVNT a 5785MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

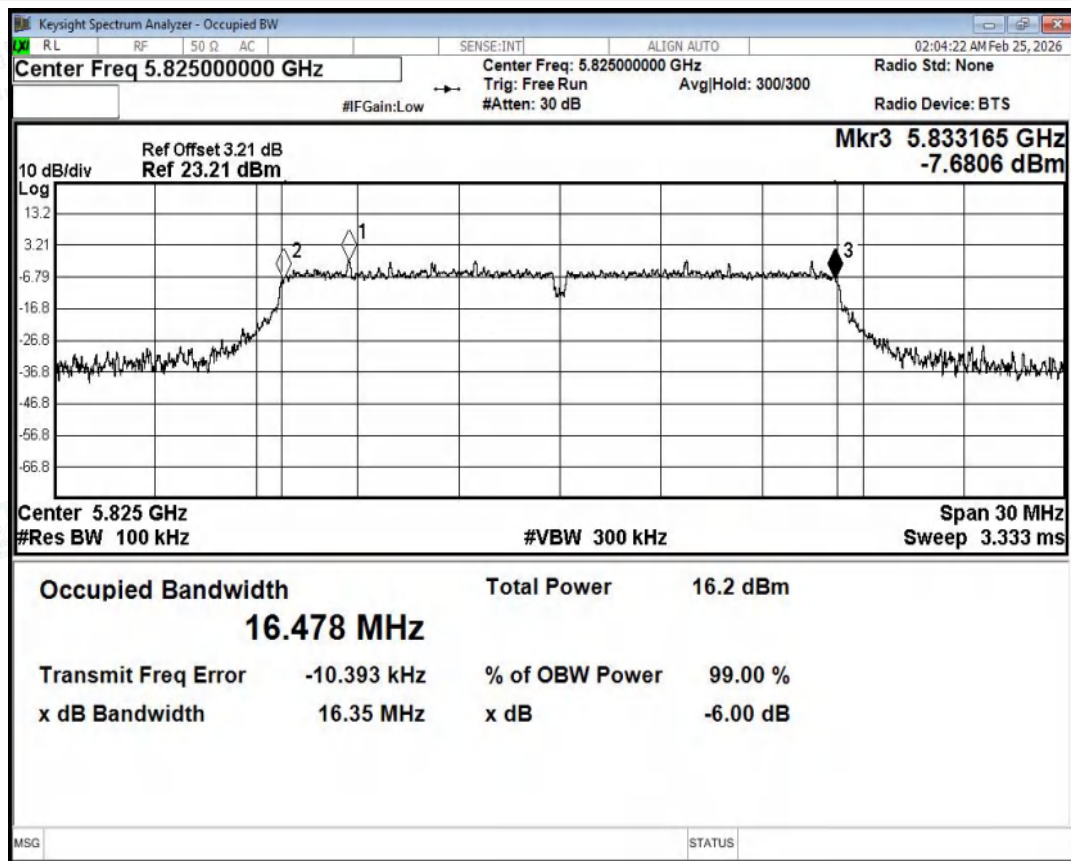

-6dB Bandwidth NVNT a 5825MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

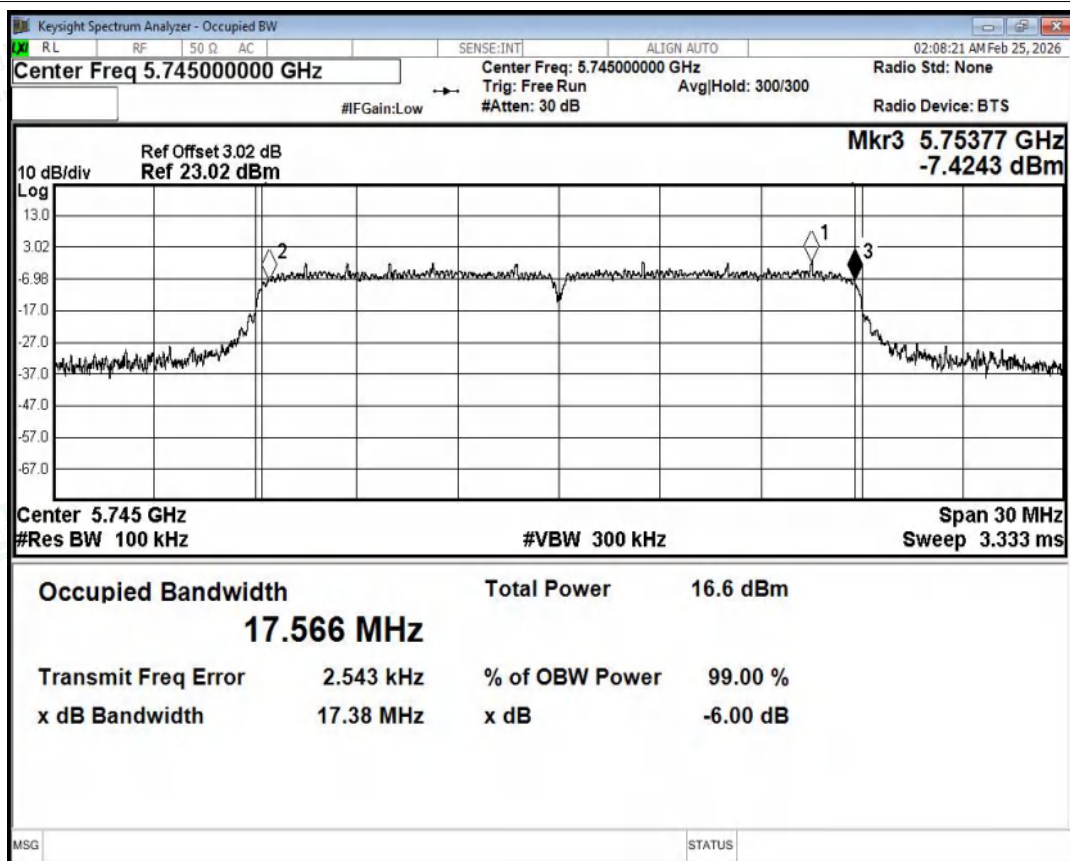

-6dB Bandwidth NVNT n20 5745MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

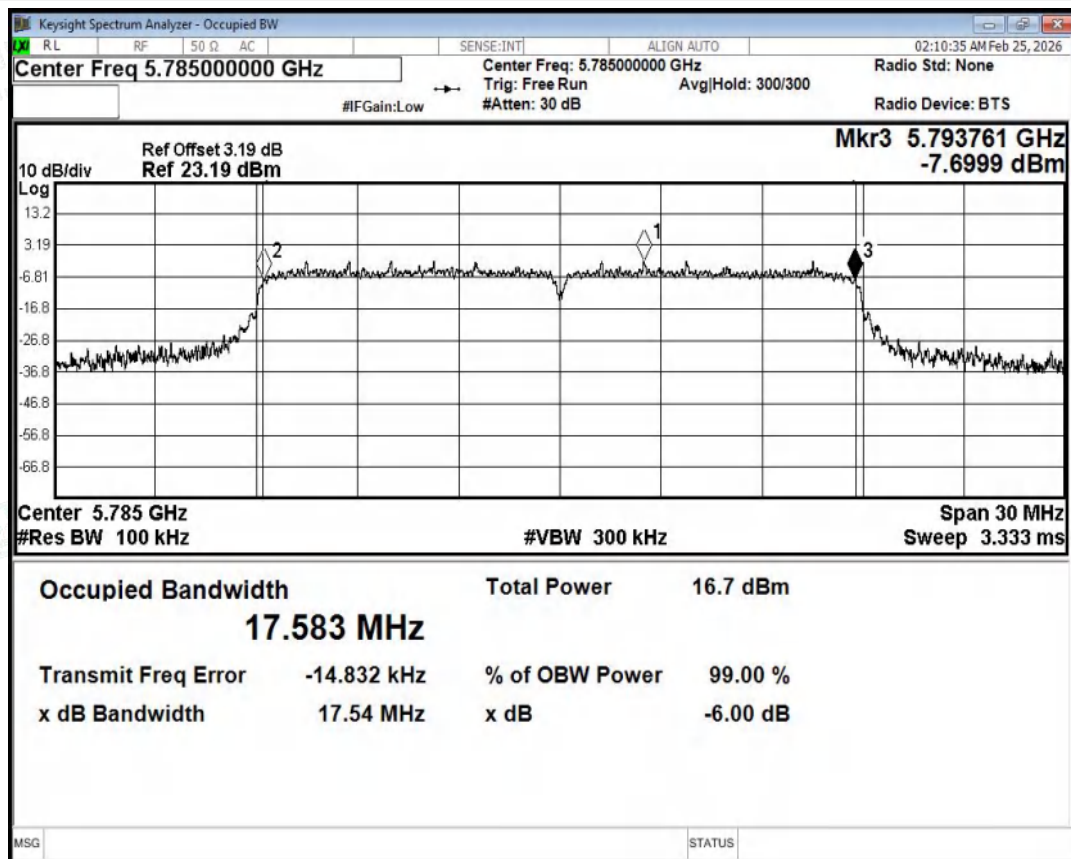

-6dB Bandwidth NVNT n20 5785MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

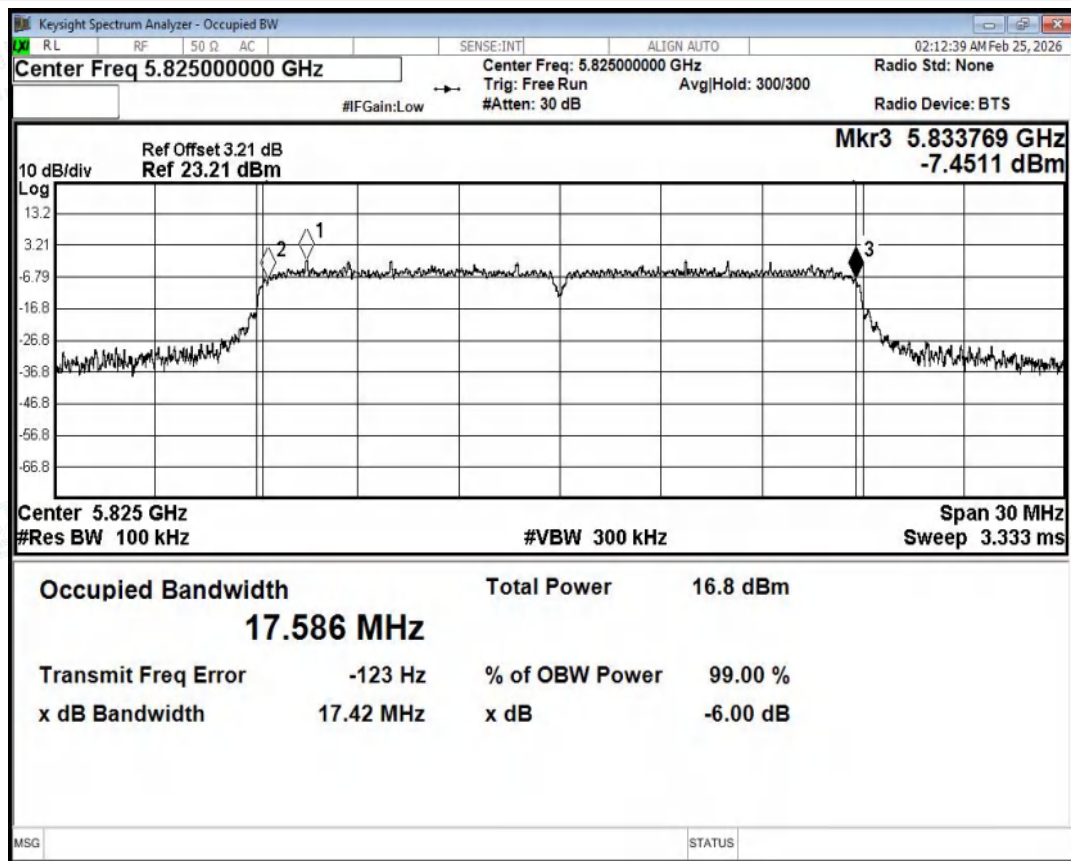

-6dB Bandwidth NVNT n20 5825MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

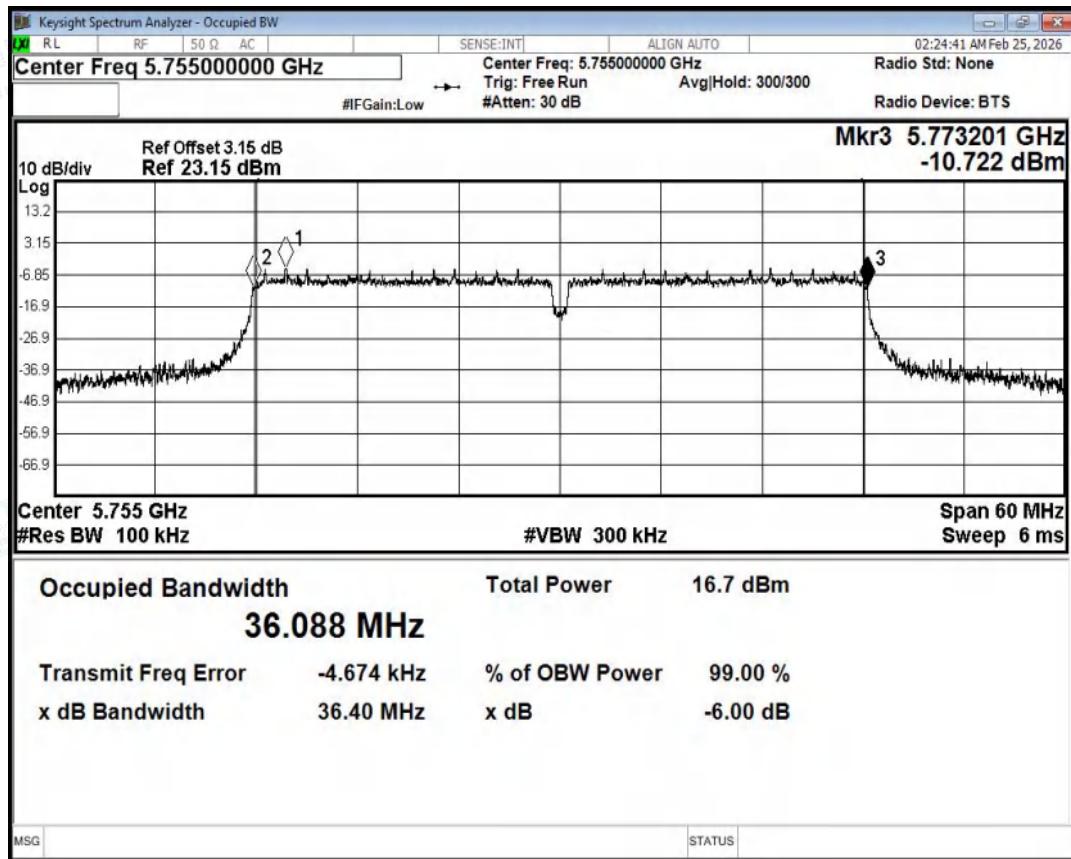

-6dB Bandwidth NVNT n40 5755MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

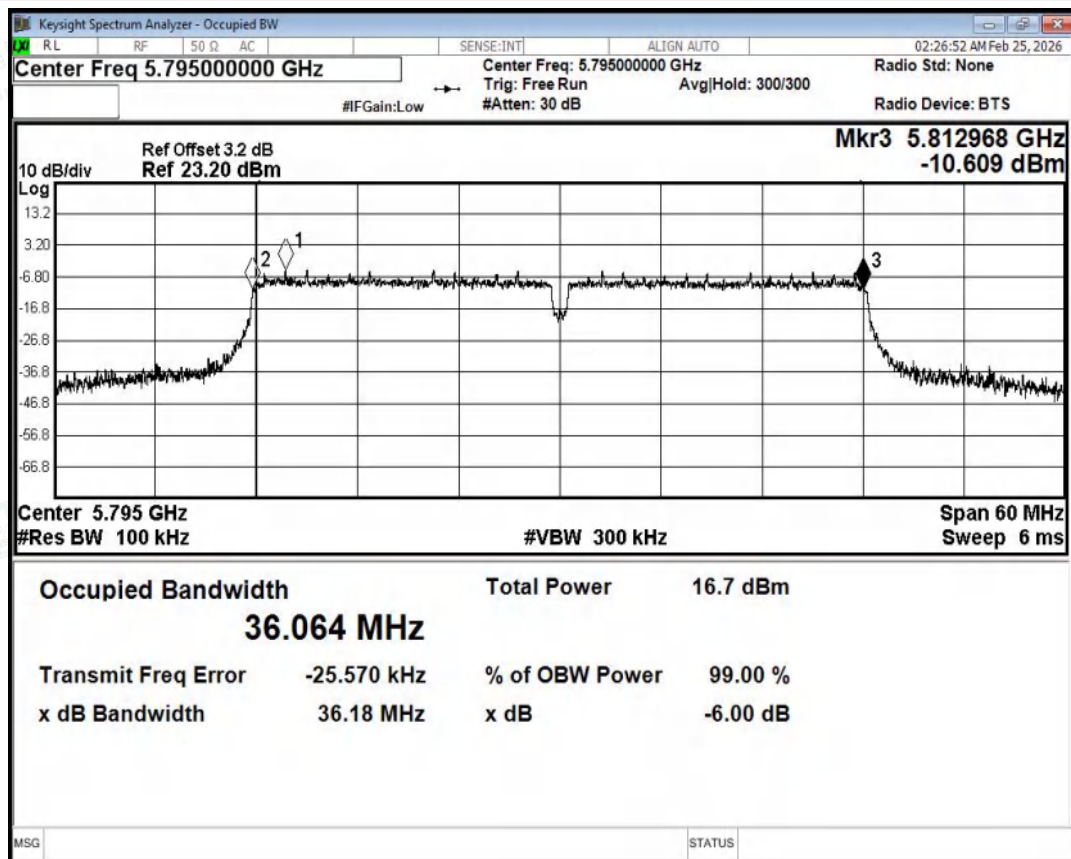

-6dB Bandwidth NVNT n40 5795MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

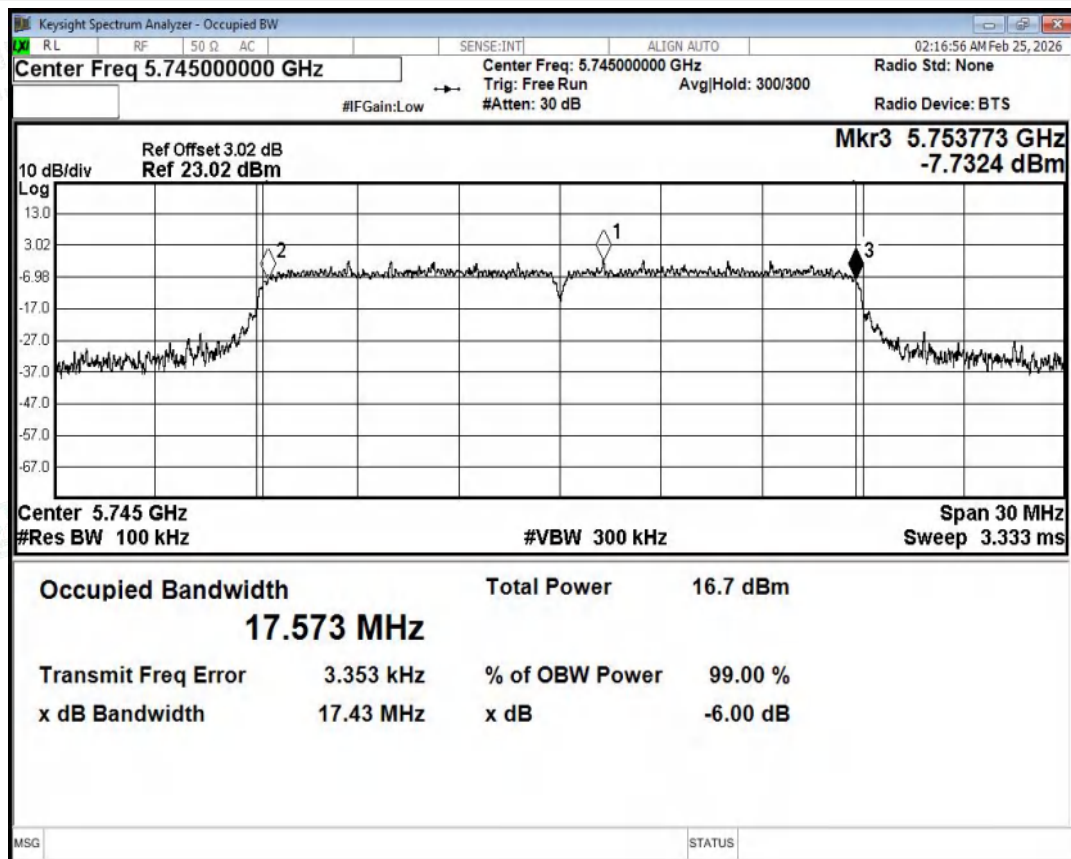

-6dB Bandwidth NVNT ac20 5745MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

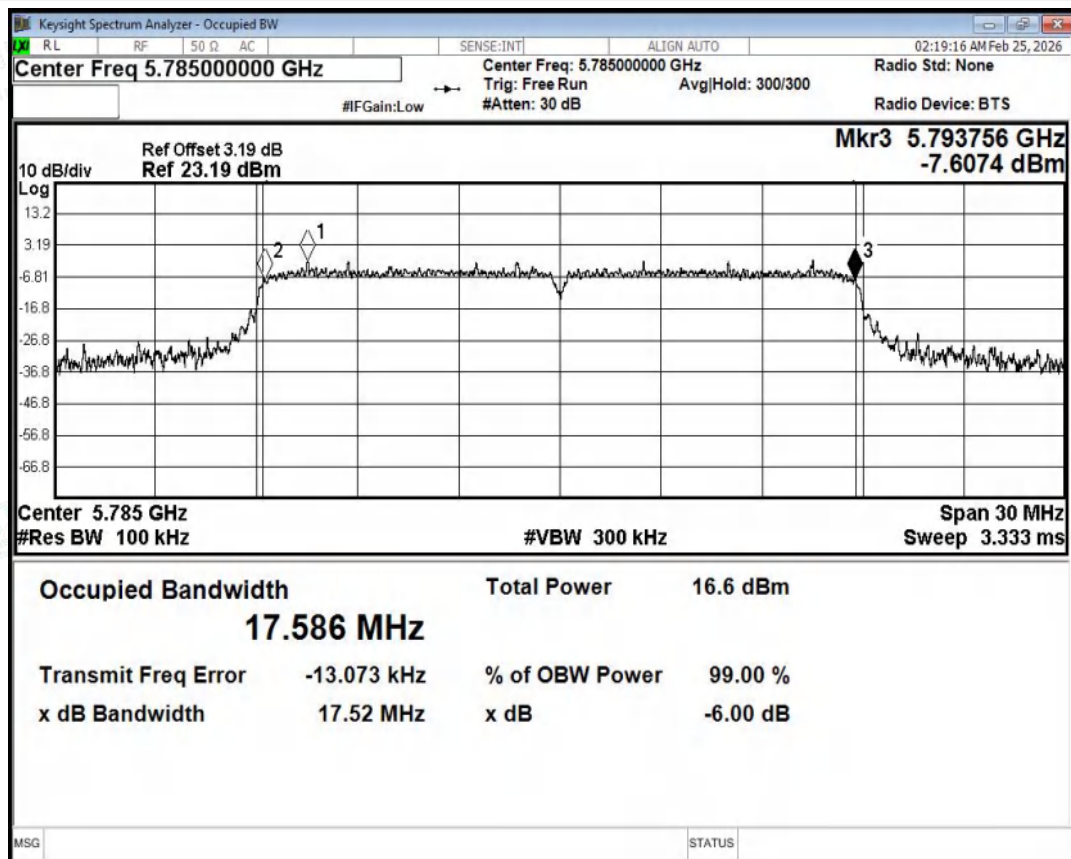

-6dB Bandwidth NVNT ac20 5785MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

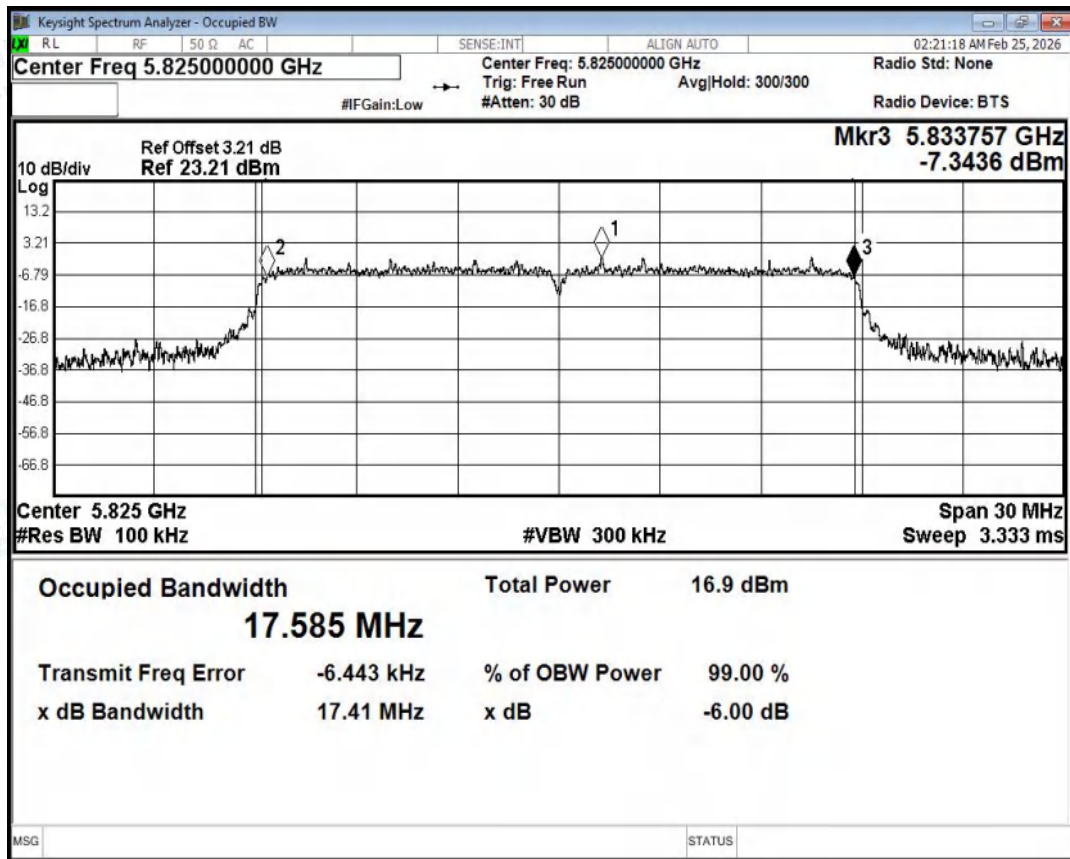

-6dB Bandwidth NVNT ac20 5825MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

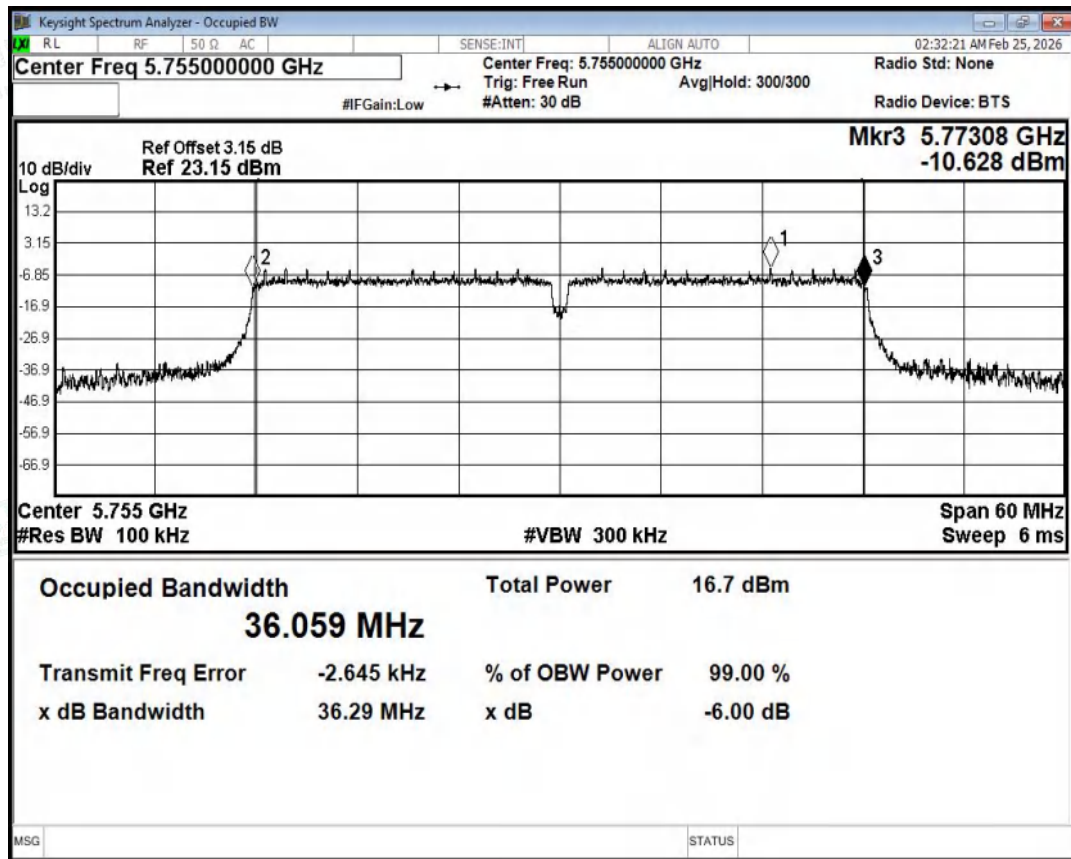

-6dB Bandwidth NVNT ac40 5755MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

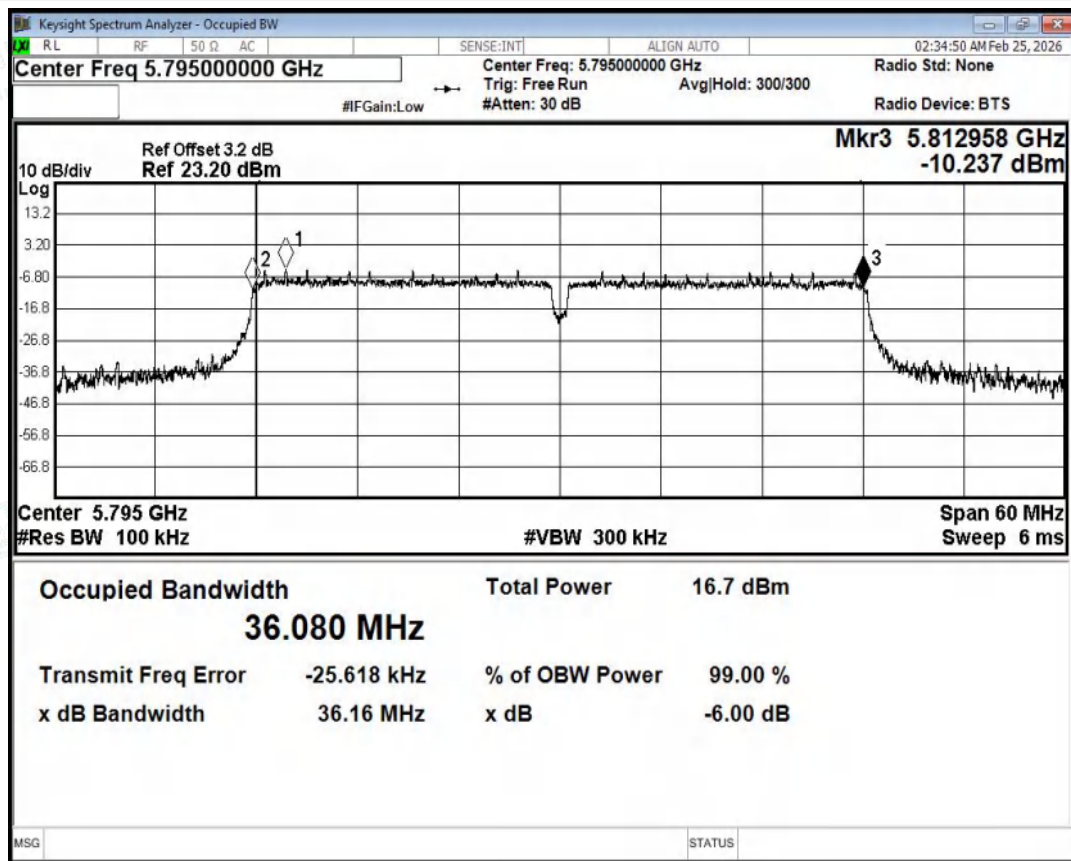

-6dB Bandwidth NVNT ac40 5795MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

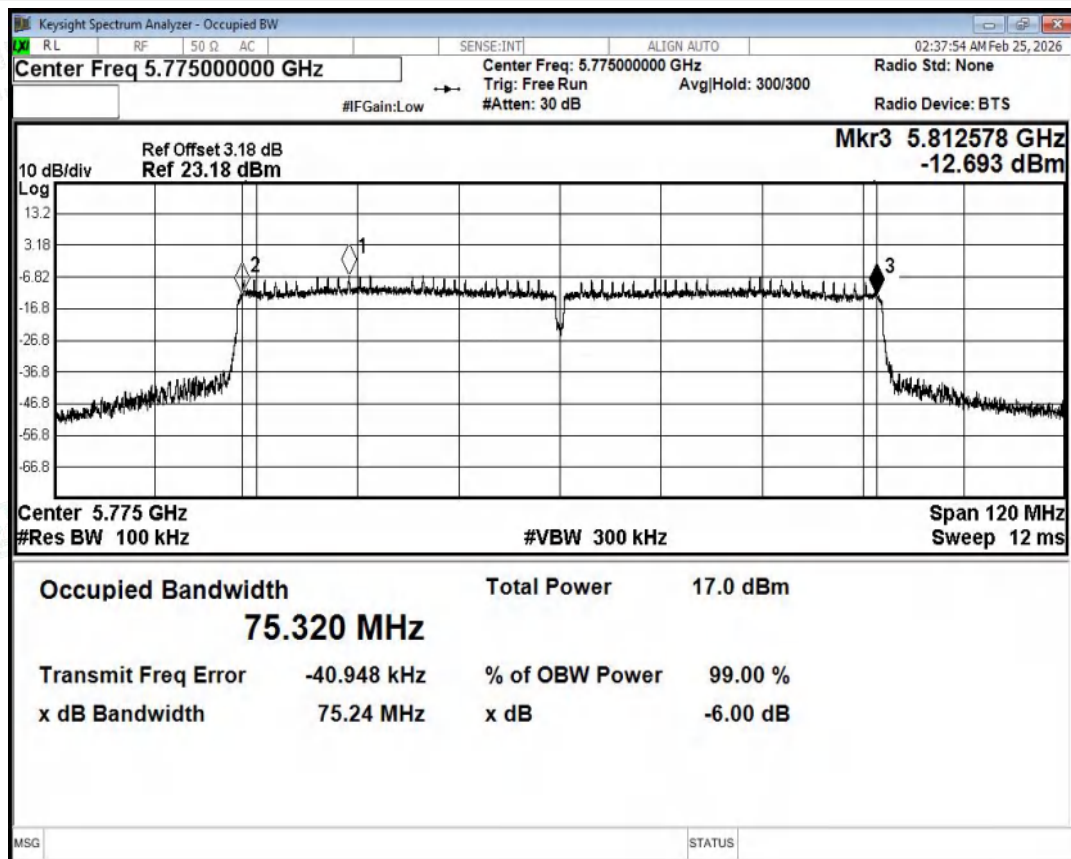

-6dB Bandwidth NVNT ac80 5775MHz Ant1



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



## E.2 Maximum Conducted Output Power

| Condition | Mode | Frequency (MHz) | Antenna | Conducted Power (dBm) | Duty Factor (dB) | Total Conducted Power (dBm) | Limit Conducted(dBm) | Verdict |
|-----------|------|-----------------|---------|-----------------------|------------------|-----------------------------|----------------------|---------|
| NVNT      | a    | 5745            | Ant1    | 12.28                 | 0.1              | 12.38                       | 30                   | Pass    |
| NVNT      | a    | 5785            | Ant1    | 12.23                 | 0.1              | 12.33                       | 30                   | Pass    |
| NVNT      | a    | 5825            | Ant1    | 12.56                 | 0.1              | 12.66                       | 30                   | Pass    |
| NVNT      | n20  | 5745            | Ant1    | 12.72                 | 0.13             | 12.85                       | 30                   | Pass    |
| NVNT      | n20  | 5785            | Ant1    | 12.69                 | 0.11             | 12.8                        | 30                   | Pass    |
| NVNT      | n20  | 5825            | Ant1    | 12.85                 | 0.13             | 12.98                       | 30                   | Pass    |
| NVNT      | n40  | 5755            | Ant1    | 12.62                 | 0.23             | 12.85                       | 30                   | Pass    |
| NVNT      | n40  | 5795            | Ant1    | 12.58                 | 0.23             | 12.81                       | 30                   | Pass    |
| NVNT      | ac20 | 5745            | Ant1    | 12.66                 | 0.11             | 12.77                       | 30                   | Pass    |
| NVNT      | ac20 | 5785            | Ant1    | 12.63                 | 0.11             | 12.74                       | 30                   | Pass    |
| NVNT      | ac20 | 5825            | Ant1    | 12.94                 | 0.11             | 13.05                       | 30                   | Pass    |
| NVNT      | ac40 | 5755            | Ant1    | 12.66                 | 0.27             | 12.93                       | 30                   | Pass    |
| NVNT      | ac40 | 5795            | Ant1    | 12.55                 | 0.23             | 12.78                       | 30                   | Pass    |
| NVNT      | ac80 | 5775            | Ant1    | 12.81                 | 0.46             | 13.27                       | 30                   | Pass    |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



### E.3 Maximum Power Spectral Density Level

| Condition | Mode | Frequency (MHz) | Antenna | Conducted PSD (dBm/500KHz) | Duty Factor (dB) | Total PSD (dBm/500KHz) | Limit (dBm/500KHz) | Verdict |
|-----------|------|-----------------|---------|----------------------------|------------------|------------------------|--------------------|---------|
| NVNT      | a    | 5745            | Ant1    | -4.47                      | 0.1              | -4.37                  | 29.4               | Pass    |
| NVNT      | a    | 5785            | Ant1    | -4.54                      | 0.1              | -4.44                  | 29.4               | Pass    |
| NVNT      | a    | 5825            | Ant1    | -4.26                      | 0.1              | -4.17                  | 29.4               | Pass    |
| NVNT      | n20  | 5745            | Ant1    | -4.43                      | 0.13             | -4.3                   | 29.4               | Pass    |
| NVNT      | n20  | 5785            | Ant1    | -4.36                      | 0.11             | -4.25                  | 29.4               | Pass    |
| NVNT      | n20  | 5825            | Ant1    | -4.39                      | 0.13             | -4.26                  | 29.4               | Pass    |
| NVNT      | n40  | 5755            | Ant1    | -7.67                      | 0.23             | -7.44                  | 29.4               | Pass    |
| NVNT      | n40  | 5795            | Ant1    | -7.21                      | 0.23             | -6.98                  | 29.4               | Pass    |
| NVNT      | ac20 | 5745            | Ant1    | -4.41                      | 0.11             | -4.3                   | 29.4               | Pass    |
| NVNT      | ac20 | 5785            | Ant1    | -4.57                      | 0.11             | -4.46                  | 29.4               | Pass    |
| NVNT      | ac20 | 5825            | Ant1    | -4.33                      | 0.11             | -4.22                  | 29.4               | Pass    |
| NVNT      | ac40 | 5755            | Ant1    | -7.8                       | 0.27             | -7.53                  | 29.4               | Pass    |
| NVNT      | ac40 | 5795            | Ant1    | -7.32                      | 0.23             | -7.09                  | 29.4               | Pass    |
| NVNT      | ac80 | 5775            | Ant1    | -10.27                     | 0.46             | -9.81                  | 29.4               | Pass    |




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

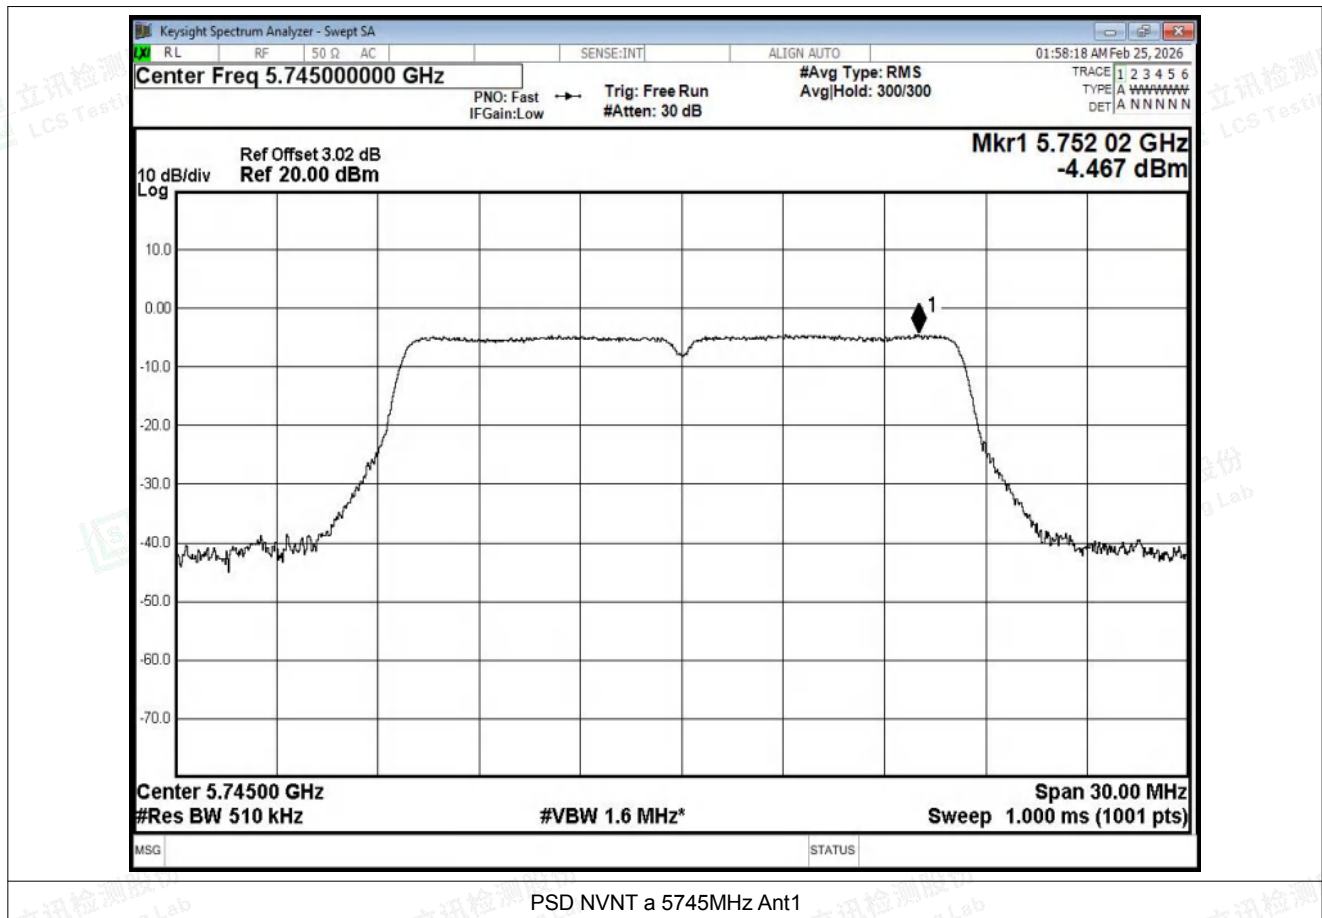

Scan code to check authenticity

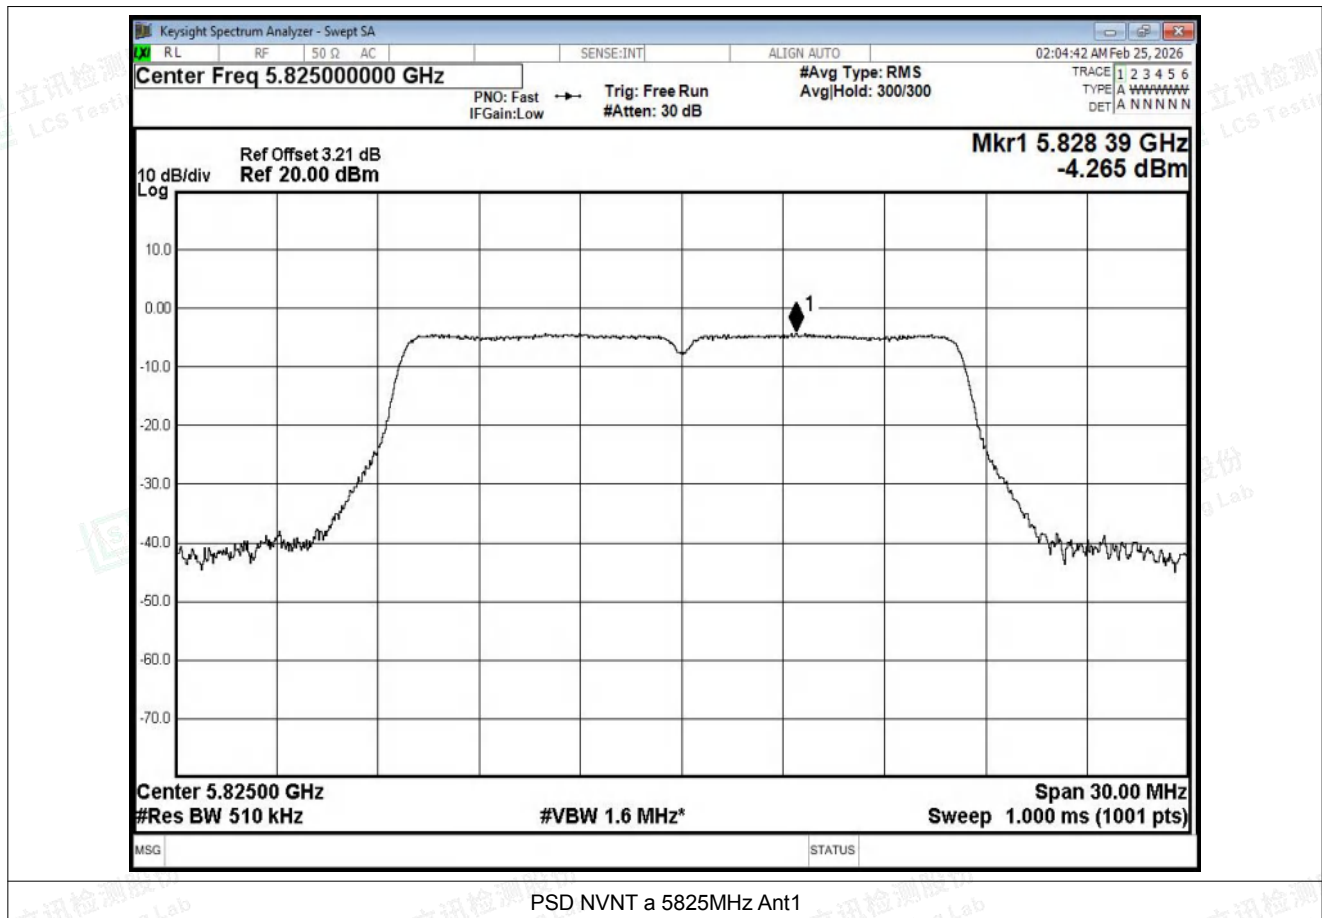



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: [webmaster@lcs-cert.com](mailto:webmaster@lcs-cert.com) | Web: [www.lcs-cert.com](http://www.lcs-cert.com)

Scan code to check authenticity

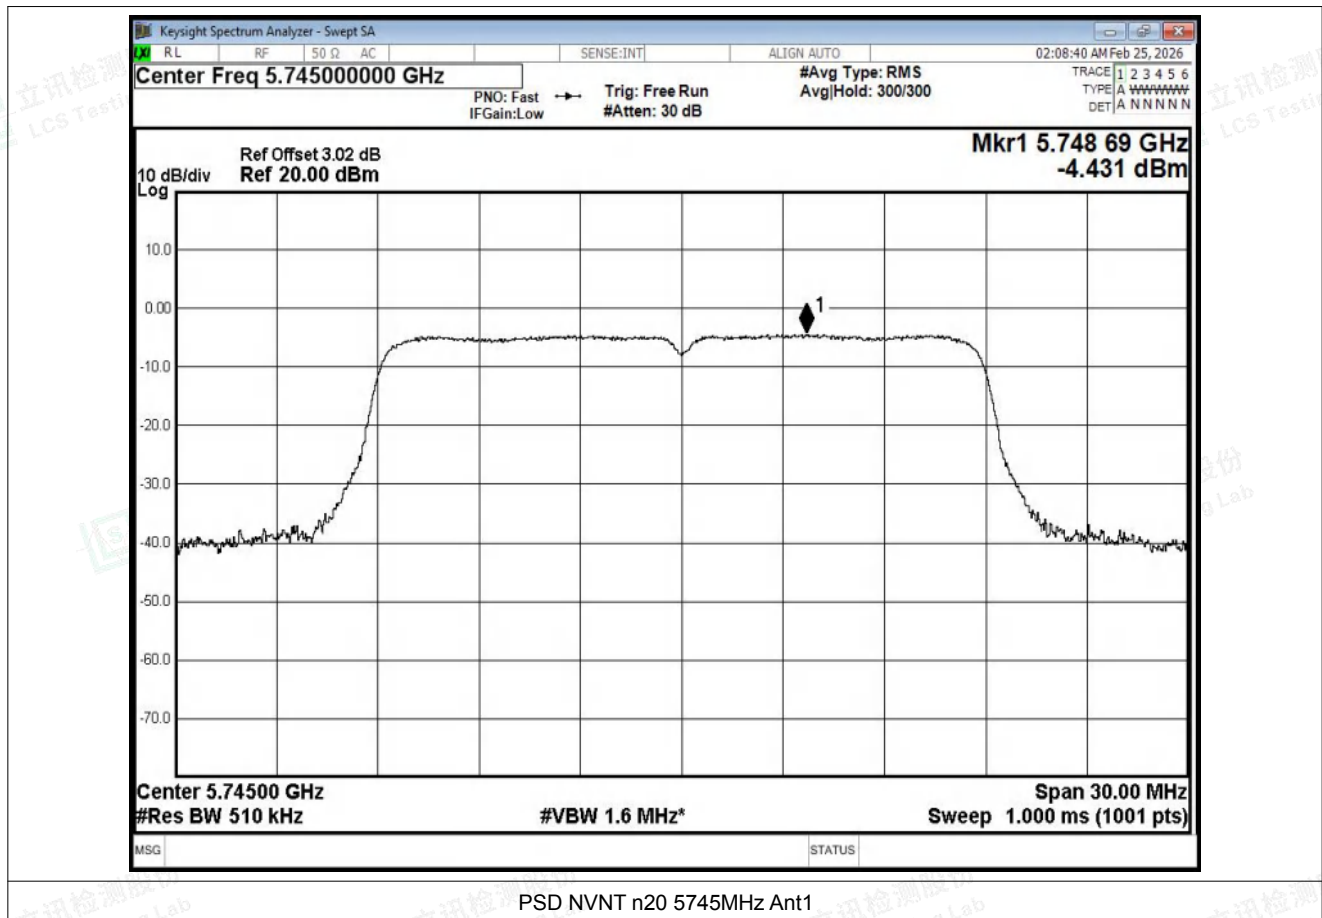

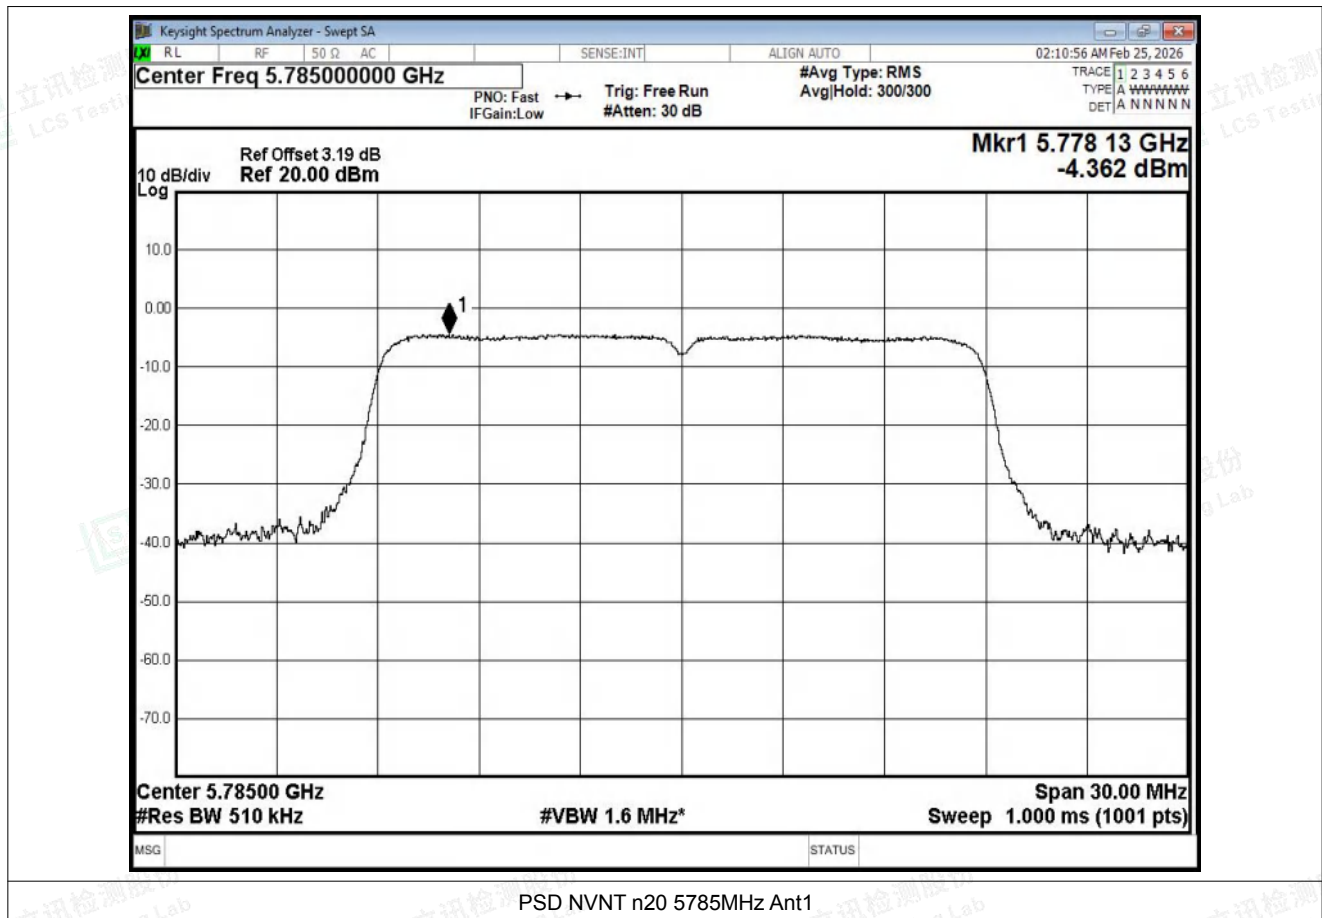


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: [webmaster@lcs-cert.com](mailto:webmaster@lcs-cert.com) | Web: [www.lcs-cert.com](http://www.lcs-cert.com)

Scan code to check authenticity

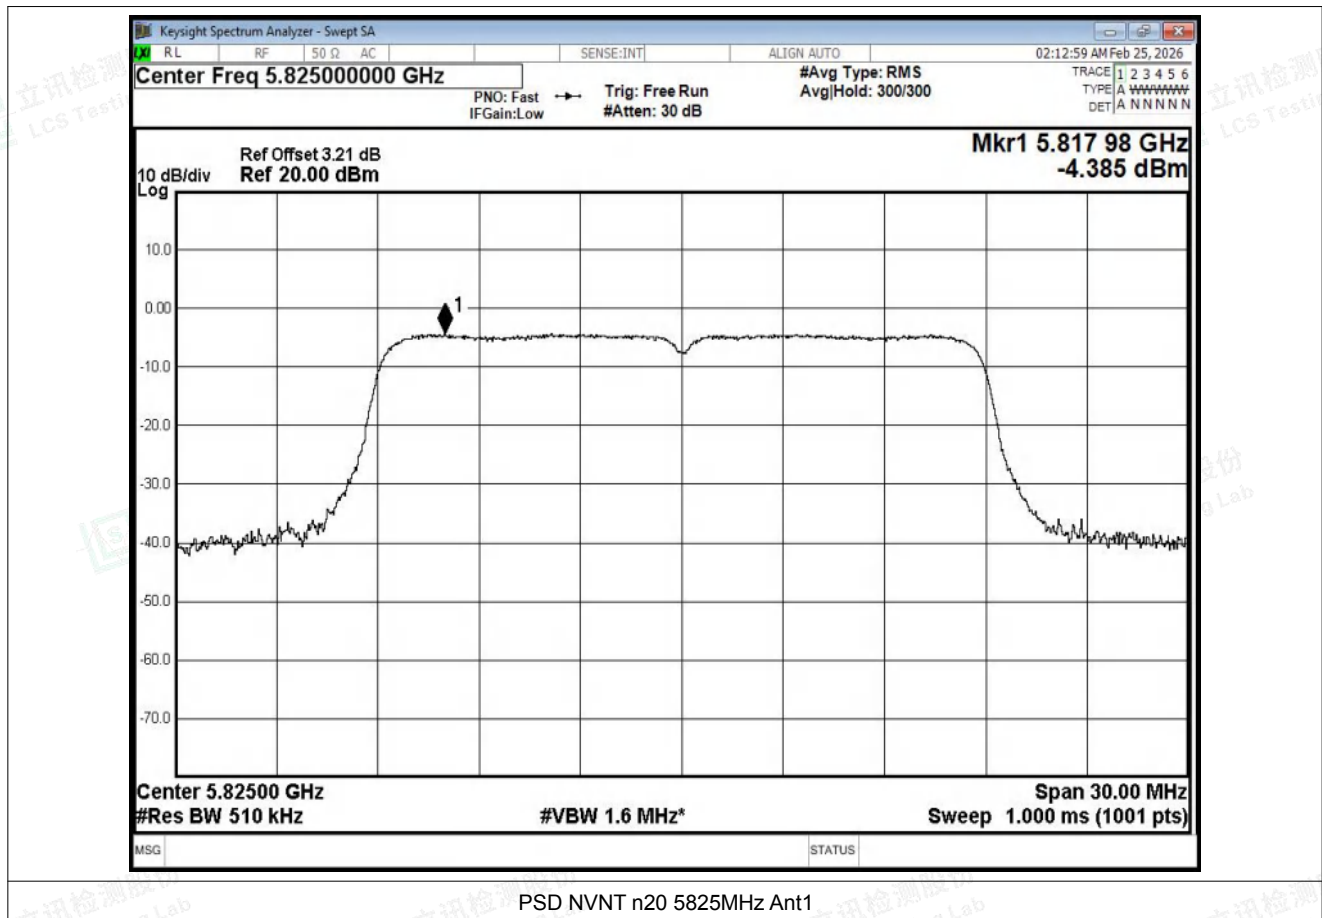


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

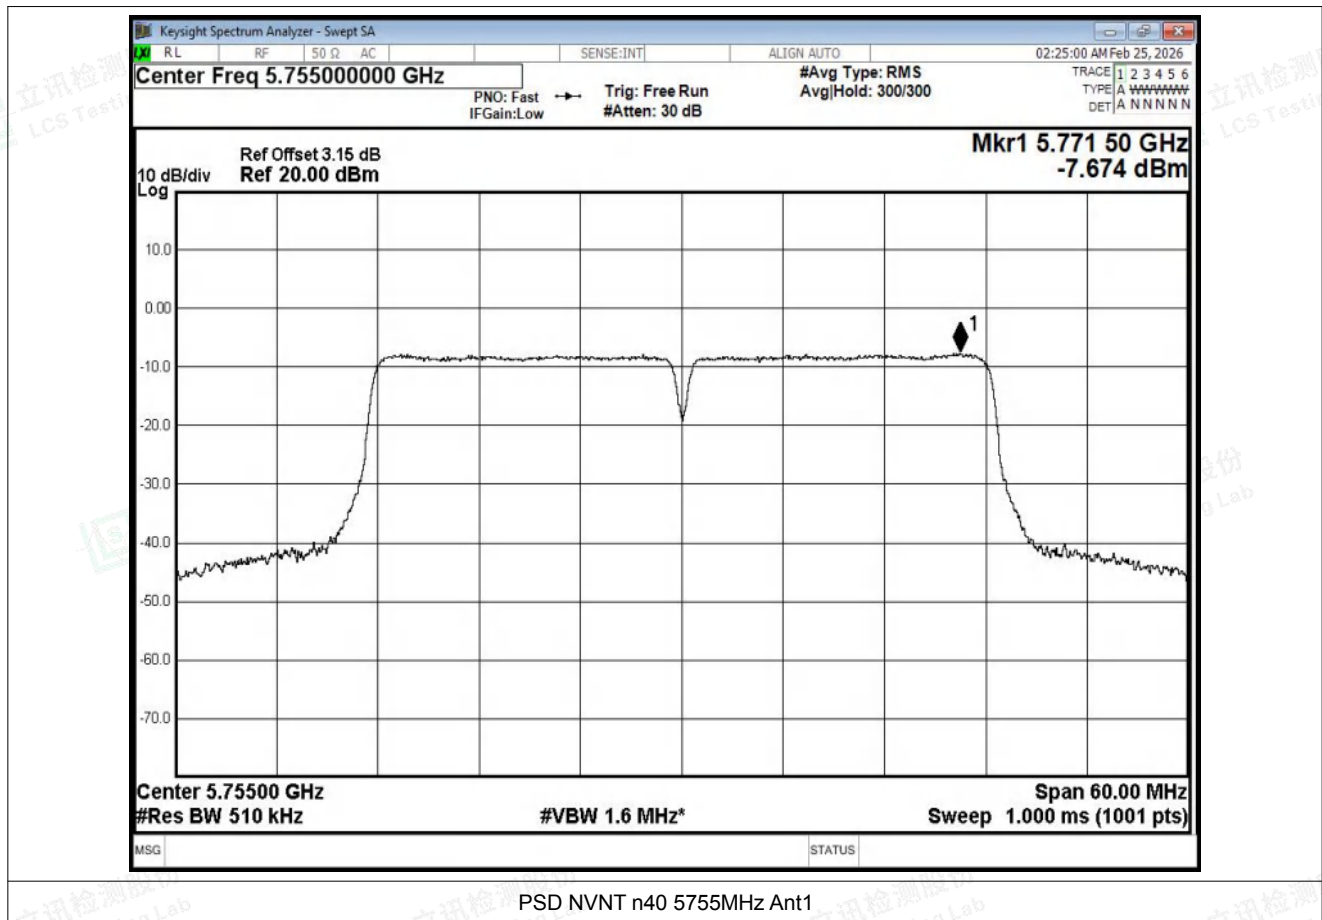


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: [webmaster@lcs-cert.com](mailto:webmaster@lcs-cert.com) | Web: [www.lcs-cert.com](http://www.lcs-cert.com)

Scan code to check authenticity

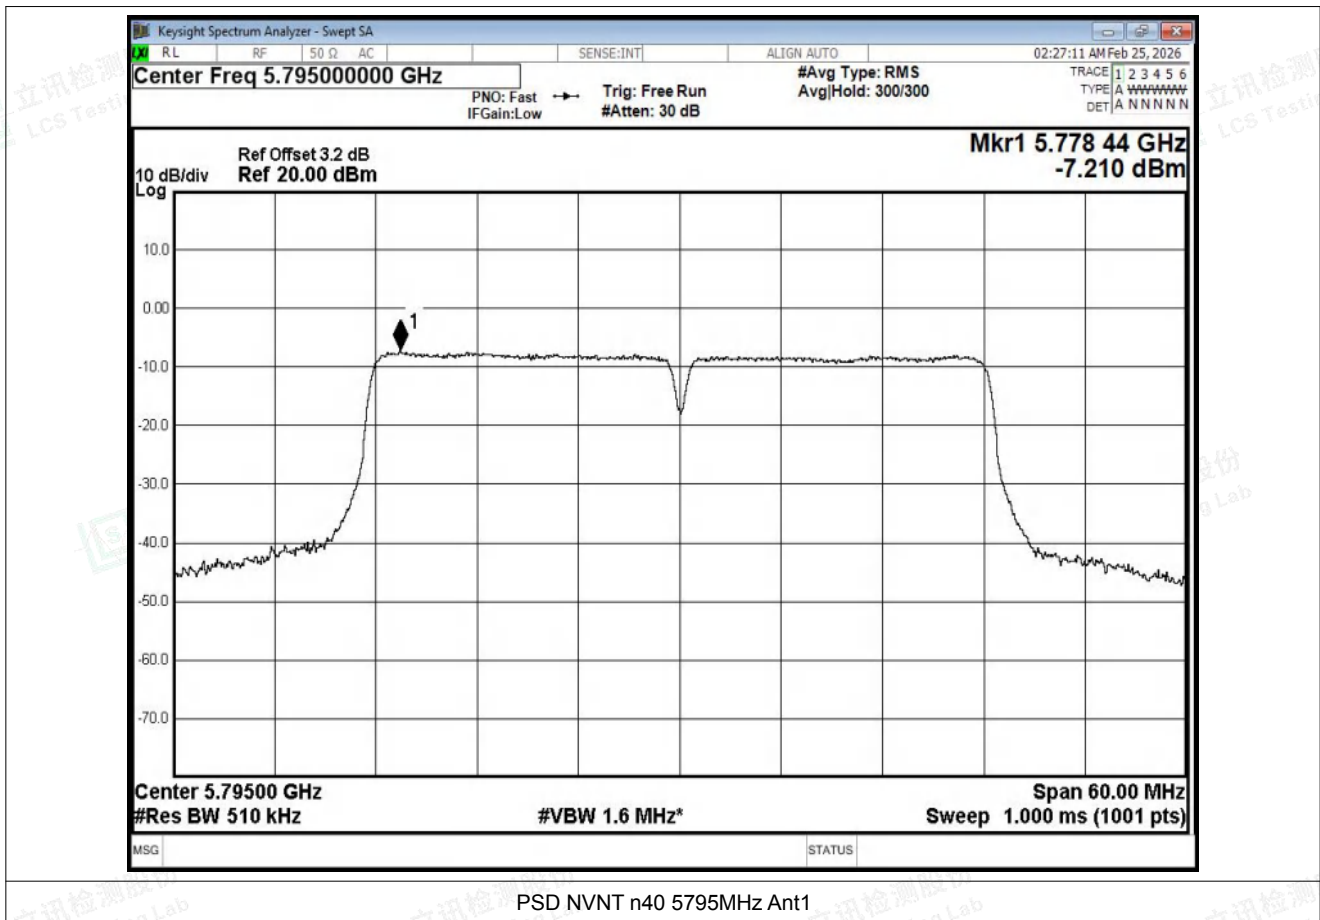


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: [webmaster@lcs-cert.com](mailto:webmaster@lcs-cert.com) | Web: [www.lcs-cert.com](http://www.lcs-cert.com)

Scan code to check authenticity

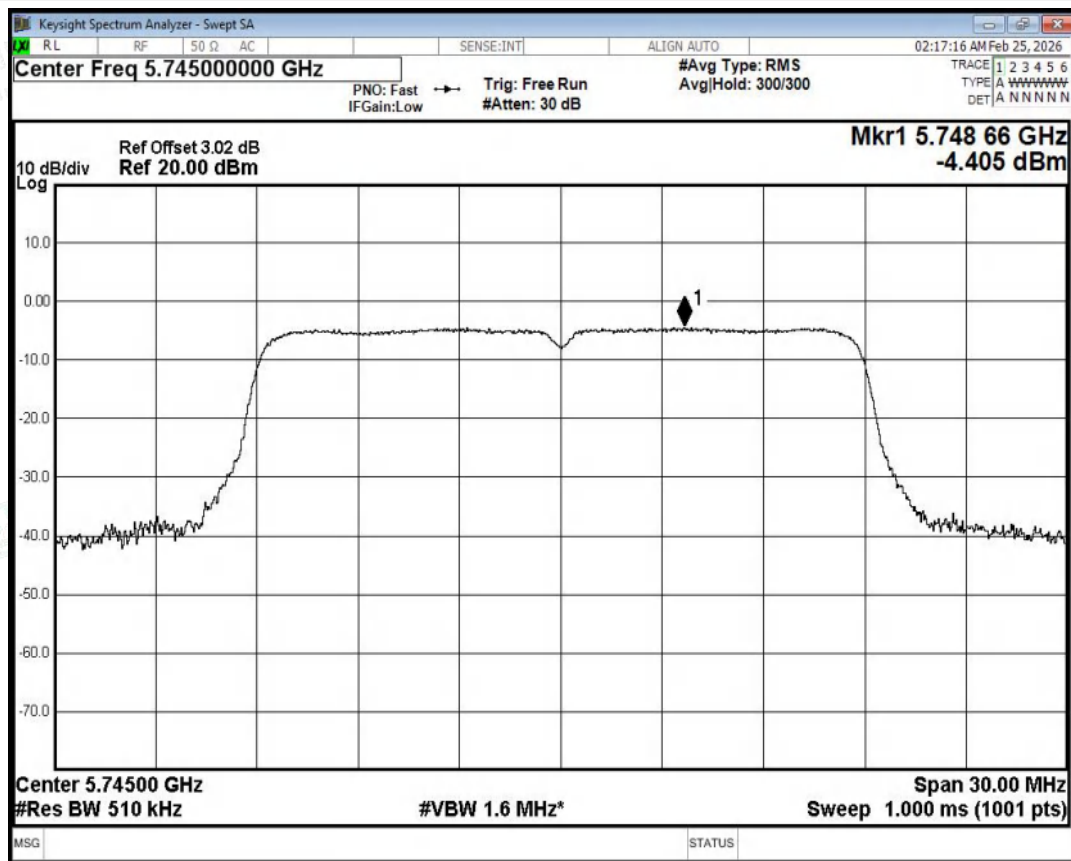

PSD NVNT ac20 5745MHz Ant1





Shenzhen LCS Compliance Testing Laboratory Ltd.

Shenzhen LSC Compliance Testing Laboratory Ltd.  
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen,  
518000, China

Tel: + (86) 0755-82591330 | E-mail: [webmaster@lcs-cert.com](mailto:webmaster@lcs-cert.com) | Web: [www.lcs-cert.com](http://www.lcs-cert.com)

Scan code to check authenticity

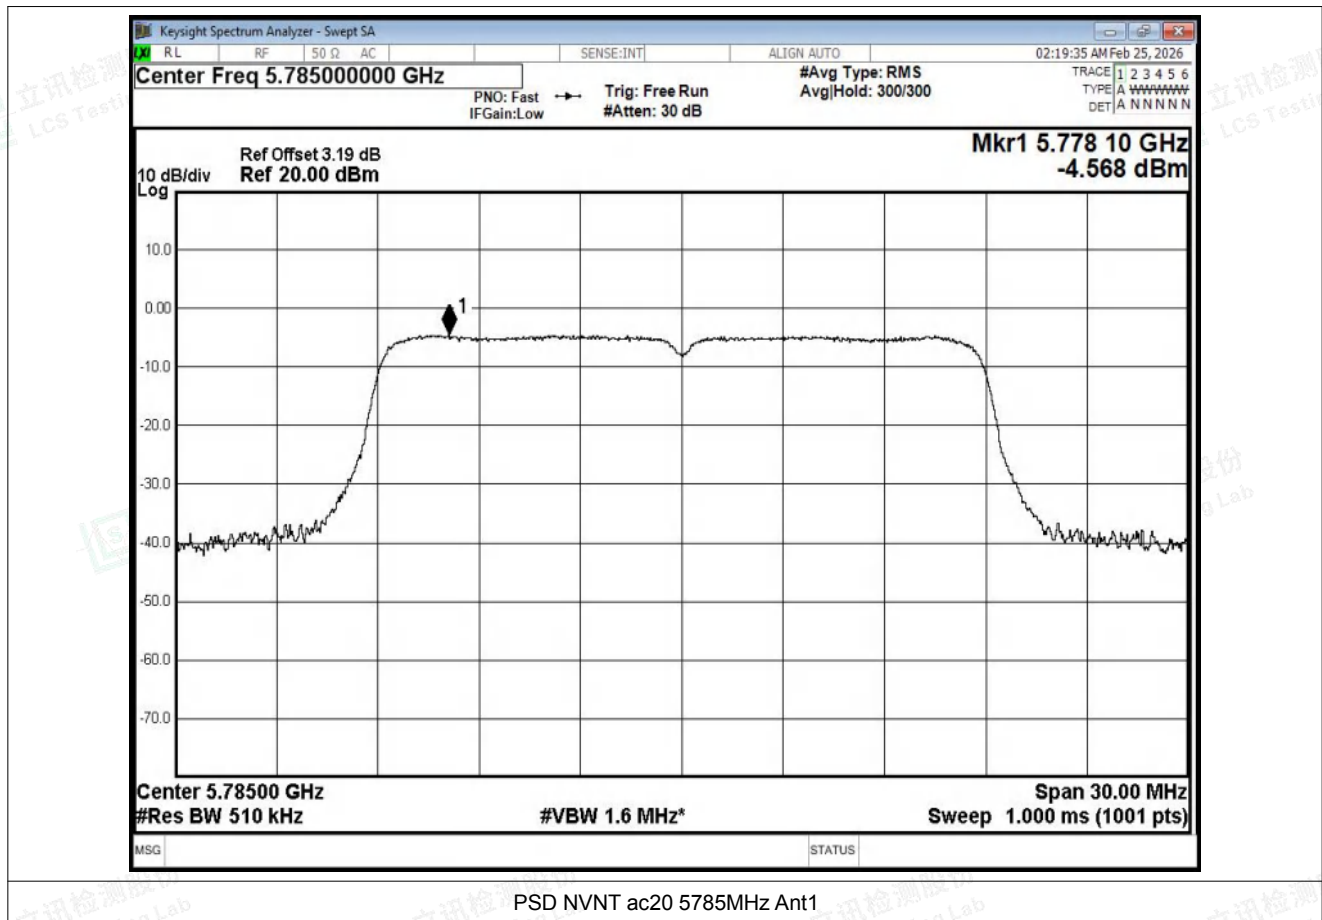

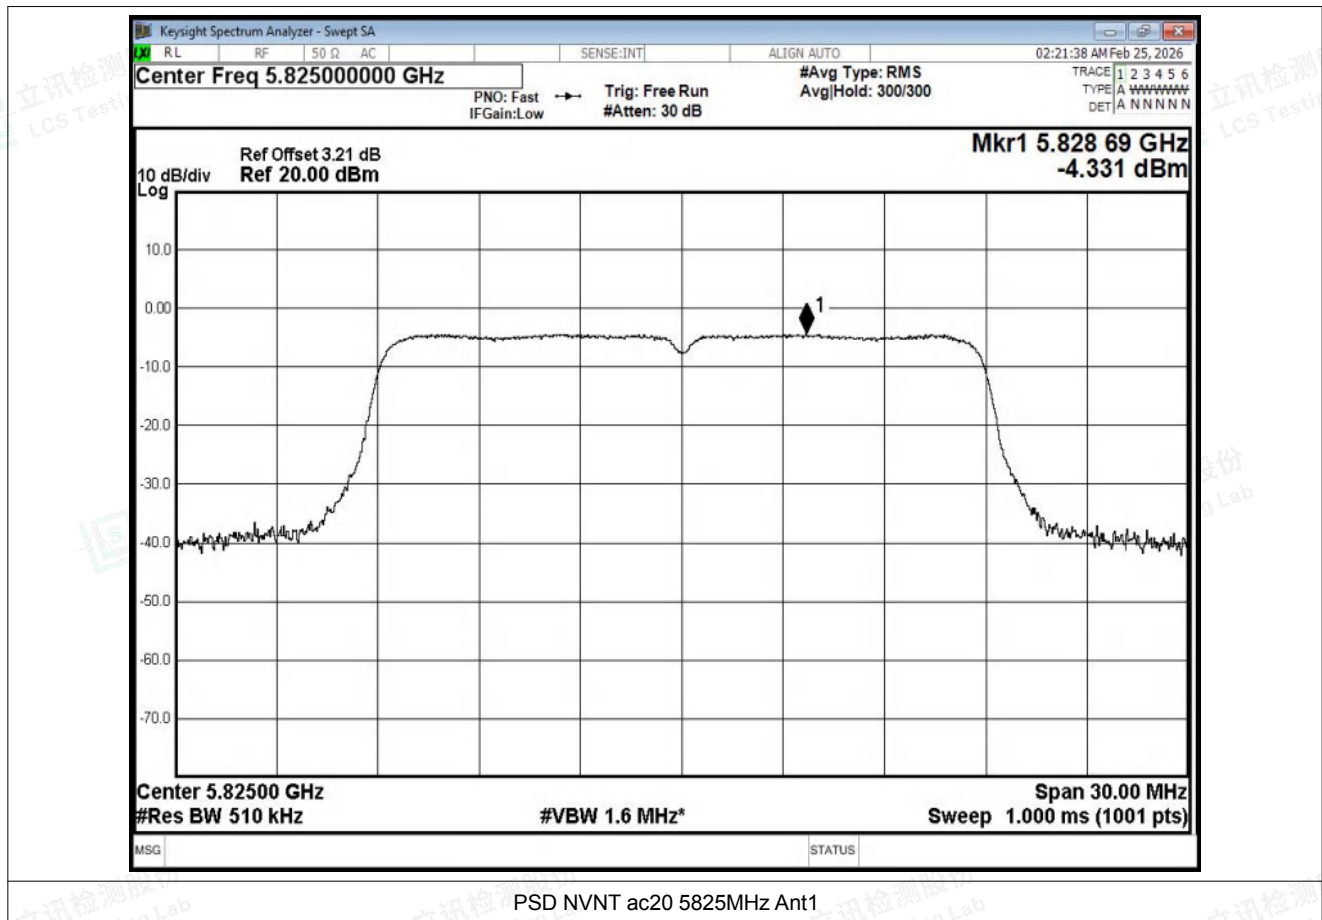



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: [webmaster@lcs-cert.com](mailto:webmaster@lcs-cert.com) | Web: [www.lcs-cert.com](http://www.lcs-cert.com)

Scan code to check authenticity

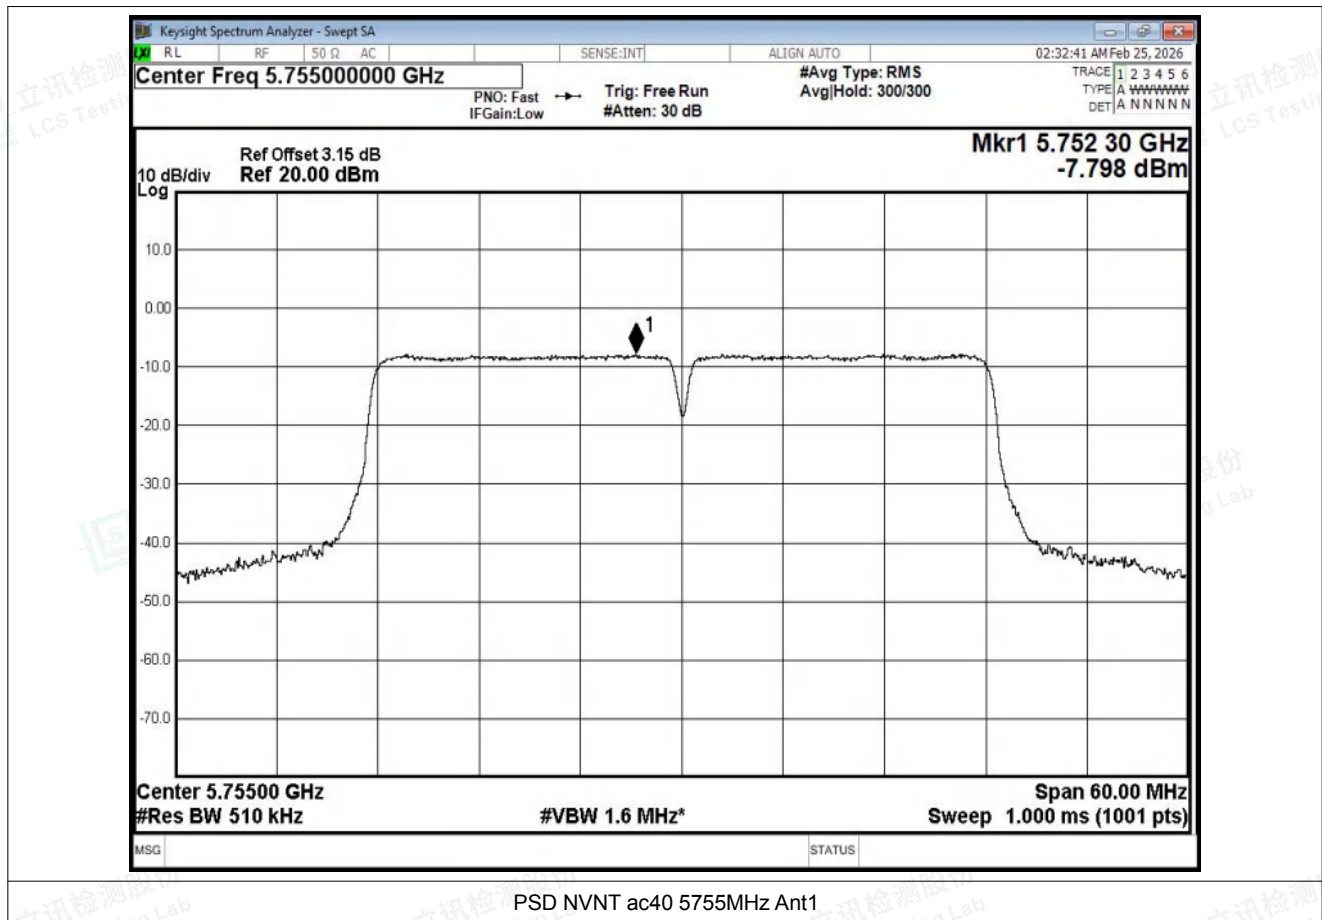

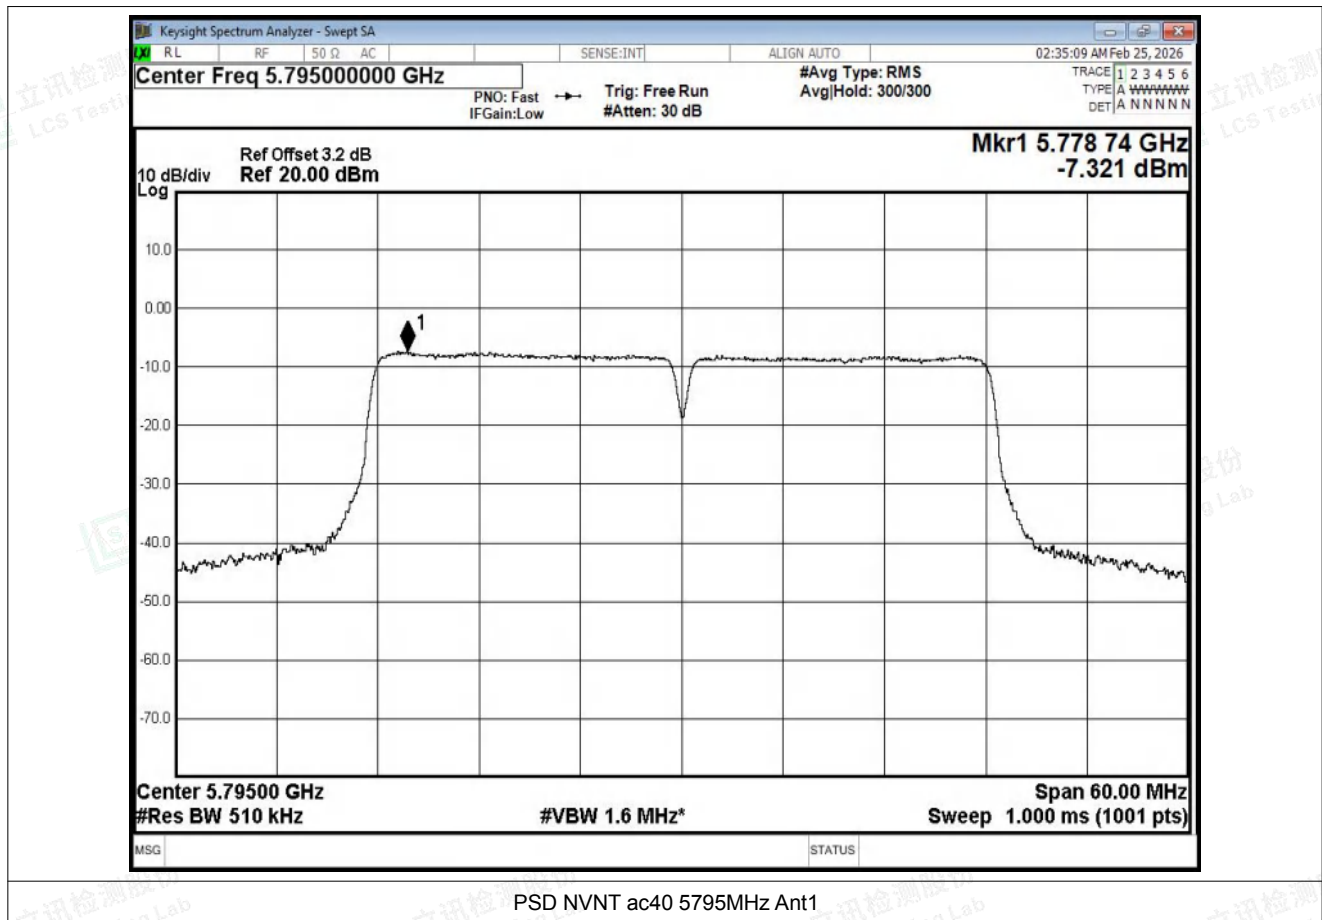


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

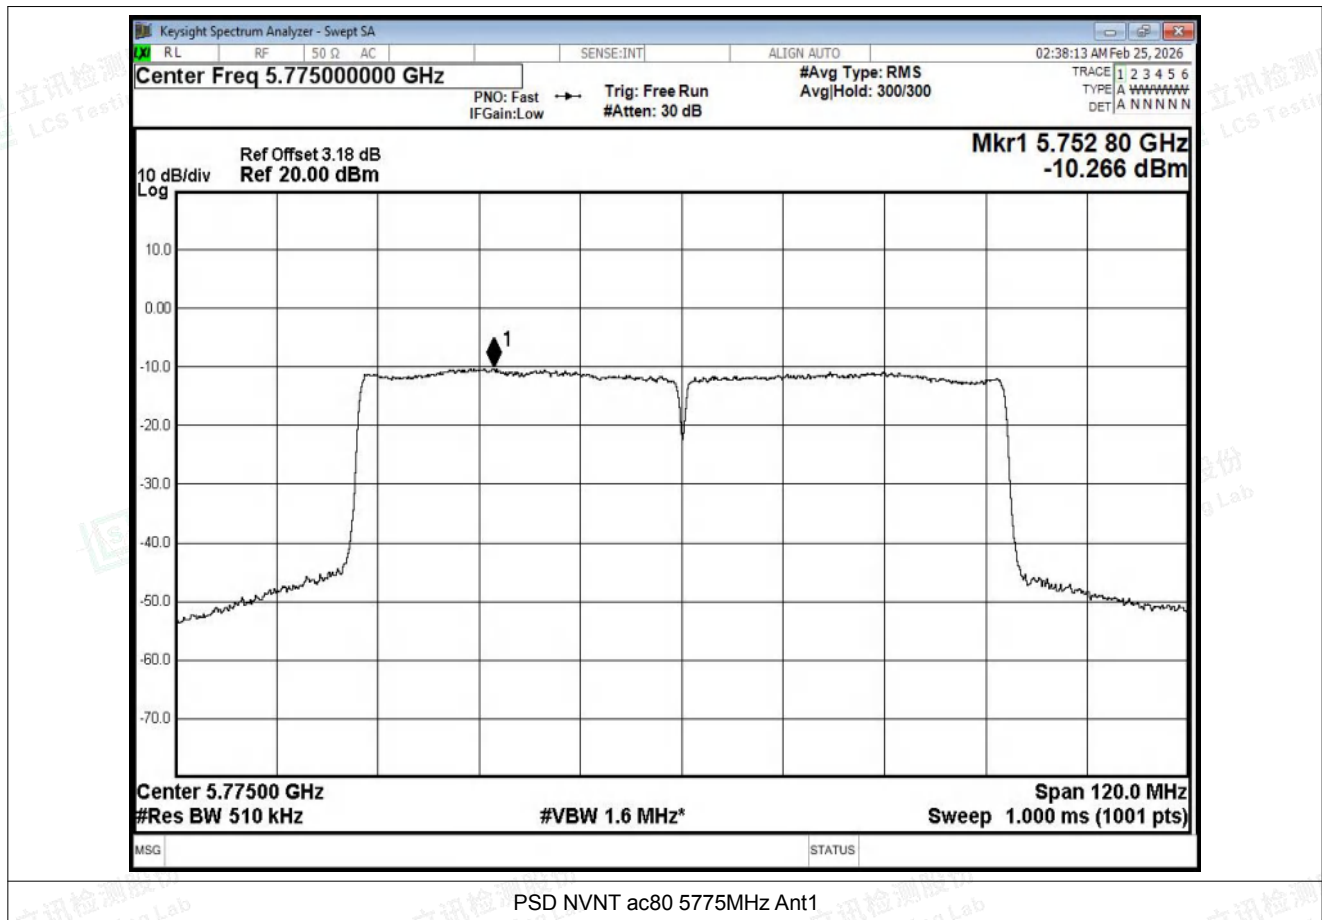

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: [webmaster@lcs-cert.com](mailto:webmaster@lcs-cert.com) | Web: [www.lcs-cert.com](http://www.lcs-cert.com)

Scan code to check authenticity



## E.4 Restrict Band

| Condition | Mode | Frequency (MHz) | Antenna | Spur Freq (MHz) | Power (dBm) | Gain (dBi) | E (dBuV/m) | Detector | Limit (dBuV/m) | Verdict |
|-----------|------|-----------------|---------|-----------------|-------------|------------|------------|----------|----------------|---------|
| NVNT      | a    | 5745            | Ant1    | 5650            | -50.53      | 3.71       | -46.82     | Peak     | -27            | Pass    |
| NVNT      | a    | 5745            | Ant1    | 5650            | -57.61      | 3.71       | -53.90     | Average  | -27            | Pass    |
| NVNT      | a    | 5745            | Ant1    | 5700            | -47.84      | 3.71       | -44.13     | Peak     | 10             | Pass    |
| NVNT      | a    | 5745            | Ant1    | 5700            | -54.89      | 3.71       | -51.18     | Average  | 10             | Pass    |
| NVNT      | a    | 5745            | Ant1    | 5720            | -34.21      | 3.71       | -30.50     | Peak     | 15.6           | Pass    |
| NVNT      | a    | 5745            | Ant1    | 5720            | -47.56      | 3.71       | -43.85     | Average  | 15.6           | Pass    |
| NVNT      | a    | 5745            | Ant1    | 5725            | -23.66      | 3.71       | -19.95     | Peak     | 27             | Pass    |
| NVNT      | a    | 5745            | Ant1    | 5725            | -41.53      | 3.71       | -37.82     | Average  | 27             | Pass    |
| NVNT      | a    | 5825            | Ant1    | 5850            | -34         | 3.71       | -30.29     | Peak     | 27             | Pass    |
| NVNT      | a    | 5825            | Ant1    | 5850            | -47.64      | 3.71       | -43.93     | Average  | 27             | Pass    |
| NVNT      | a    | 5825            | Ant1    | 5855            | -42.77      | 3.71       | -39.06     | Peak     | 15.6           | Pass    |
| NVNT      | a    | 5825            | Ant1    | 5855            | -52.17      | 3.71       | -48.46     | Average  | 15.6           | Pass    |
| NVNT      | a    | 5825            | Ant1    | 5875            | -48.15      | 3.71       | -44.44     | Peak     | 10             | Pass    |
| NVNT      | a    | 5825            | Ant1    | 5875            | -54.83      | 3.71       | -51.12     | Average  | 10             | Pass    |
| NVNT      | a    | 5825            | Ant1    | 5925            | -49.21      | 3.71       | -45.50     | Peak     | -27            | Pass    |
| NVNT      | a    | 5825            | Ant1    | 5925            | -55.9       | 3.71       | -52.19     | Average  | -27            | Pass    |
| NVNT      | n20  | 5745            | Ant1    | 5650            | -49.92      | 3.71       | -46.21     | Peak     | -27            | Pass    |
| NVNT      | n20  | 5745            | Ant1    | 5650            | -57.23      | 3.71       | -53.52     | Average  | -27            | Pass    |
| NVNT      | n20  | 5745            | Ant1    | 5700            | -47.92      | 3.71       | -44.21     | Peak     | 10             | Pass    |
| NVNT      | n20  | 5745            | Ant1    | 5700            | -54.76      | 3.71       | -51.05     | Average  | 10             | Pass    |
| NVNT      | n20  | 5745            | Ant1    | 5720            | -30.71      | 3.71       | -27.00     | Peak     | 15.6           | Pass    |
| NVNT      | n20  | 5745            | Ant1    | 5720            | -45.06      | 3.71       | -41.35     | Average  | 15.6           | Pass    |
| NVNT      | n20  | 5745            | Ant1    | 5725            | -24.81      | 3.71       | -21.10     | Peak     | 27             | Pass    |
| NVNT      | n20  | 5745            | Ant1    | 5725            | -38.51      | 3.71       | -34.80     | Average  | 27             | Pass    |
| NVNT      | n20  | 5825            | Ant1    | 5850            | -29.8       | 3.71       | -26.09     | Peak     | 27             | Pass    |
| NVNT      | n20  | 5825            | Ant1    | 5850            | -43.12      | 3.71       | -39.41     | Average  | 27             | Pass    |
| NVNT      | n20  | 5825            | Ant1    | 5855            | -36.07      | 3.71       | -32.36     | Peak     | 15.6           | Pass    |
| NVNT      | n20  | 5825            | Ant1    | 5855            | -47.92      | 3.71       | -44.21     | Average  | 15.6           | Pass    |
| NVNT      | n20  | 5825            | Ant1    | 5875            | -47.18      | 3.71       | -43.47     | Peak     | 10             | Pass    |
| NVNT      | n20  | 5825            | Ant1    | 5875            | -54.78      | 3.71       | -51.07     | Average  | 10             | Pass    |
| NVNT      | n20  | 5825            | Ant1    | 5925            | -47.74      | 3.71       | -44.03     | Peak     | -27            | Pass    |
| NVNT      | n20  | 5825            | Ant1    | 5925            | -55.88      | 3.71       | -52.17     | Average  | -27            | Pass    |
| NVNT      | n40  | 5755            | Ant1    | 5650            | -49.05      | 3.71       | -45.34     | Peak     | -27            | Pass    |
| NVNT      | n40  | 5755            | Ant1    | 5650            | -57.1       | 3.71       | -53.39     | Average  | -27            | Pass    |
| NVNT      | n40  | 5755            | Ant1    | 5700            | -45.33      | 3.71       | -41.62     | Peak     | 10             | Pass    |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



|      |      |      |      |      |        |      |        |         |      |      |
|------|------|------|------|------|--------|------|--------|---------|------|------|
| NVNT | n40  | 5755 | Ant1 | 5700 | -52.43 | 3.71 | -48.72 | Average | 10   | Pass |
| NVNT | n40  | 5755 | Ant1 | 5720 | -31.69 | 3.71 | -27.98 | Peak    | 15.6 | Pass |
| NVNT | n40  | 5755 | Ant1 | 5720 | -42.52 | 3.71 | -38.81 | Average | 15.6 | Pass |
| NVNT | n40  | 5755 | Ant1 | 5725 | -26.12 | 3.71 | -22.41 | Peak    | 27   | Pass |
| NVNT | n40  | 5755 | Ant1 | 5725 | -39.73 | 3.71 | -36.02 | Average | 27   | Pass |
| NVNT | n40  | 5795 | Ant1 | 5850 | -48.55 | 3.71 | -44.84 | Peak    | 27   | Pass |
| NVNT | n40  | 5795 | Ant1 | 5850 | -54.04 | 3.71 | -50.33 | Average | 27   | Pass |
| NVNT | n40  | 5795 | Ant1 | 5855 | -47.83 | 3.71 | -44.12 | Peak    | 15.6 | Pass |
| NVNT | n40  | 5795 | Ant1 | 5855 | -54.42 | 3.71 | -50.71 | Average | 15.6 | Pass |
| NVNT | n40  | 5795 | Ant1 | 5875 | -48.42 | 3.71 | -44.71 | Peak    | 10   | Pass |
| NVNT | n40  | 5795 | Ant1 | 5875 | -55.94 | 3.71 | -52.23 | Average | 10   | Pass |
| NVNT | n40  | 5795 | Ant1 | 5925 | -49.55 | 3.71 | -45.84 | Peak    | -27  | Pass |
| NVNT | n40  | 5795 | Ant1 | 5925 | -56.59 | 3.71 | -52.88 | Average | -27  | Pass |
| NVNT | ac20 | 5745 | Ant1 | 5650 | -50.46 | 3.71 | -46.75 | Peak    | -27  | Pass |
| NVNT | ac20 | 5745 | Ant1 | 5650 | -57.26 | 3.71 | -53.55 | Average | -27  | Pass |
| NVNT | ac20 | 5745 | Ant1 | 5700 | -46.57 | 3.71 | -42.86 | Peak    | 10   | Pass |
| NVNT | ac20 | 5745 | Ant1 | 5700 | -54.72 | 3.71 | -51.01 | Average | 10   | Pass |
| NVNT | ac20 | 5745 | Ant1 | 5720 | -35.04 | 3.71 | -31.33 | Peak    | 15.6 | Pass |
| NVNT | ac20 | 5745 | Ant1 | 5720 | -45.84 | 3.71 | -42.13 | Average | 15.6 | Pass |
| NVNT | ac20 | 5745 | Ant1 | 5725 | -25.62 | 3.71 | -21.91 | Peak    | 27   | Pass |
| NVNT | ac20 | 5745 | Ant1 | 5725 | -39.13 | 3.71 | -35.42 | Average | 27   | Pass |
| NVNT | ac20 | 5825 | Ant1 | 5850 | -32.23 | 3.71 | -28.52 | Peak    | 27   | Pass |
| NVNT | ac20 | 5825 | Ant1 | 5850 | -42.55 | 3.71 | -38.84 | Average | 27   | Pass |
| NVNT | ac20 | 5825 | Ant1 | 5855 | -38.33 | 3.71 | -34.62 | Peak    | 15.6 | Pass |
| NVNT | ac20 | 5825 | Ant1 | 5855 | -47.18 | 3.71 | -43.47 | Average | 15.6 | Pass |
| NVNT | ac20 | 5825 | Ant1 | 5875 | -46.82 | 3.71 | -43.11 | Peak    | 10   | Pass |
| NVNT | ac20 | 5825 | Ant1 | 5875 | -54.81 | 3.71 | -51.10 | Average | 10   | Pass |
| NVNT | ac20 | 5825 | Ant1 | 5925 | -48.34 | 3.71 | -44.63 | Peak    | -27  | Pass |
| NVNT | ac20 | 5825 | Ant1 | 5925 | -55.99 | 3.71 | -52.28 | Average | -27  | Pass |
| NVNT | ac40 | 5755 | Ant1 | 5650 | -51.17 | 3.71 | -47.46 | Peak    | -27  | Pass |
| NVNT | ac40 | 5755 | Ant1 | 5650 | -57.13 | 3.71 | -53.42 | Average | -27  | Pass |
| NVNT | ac40 | 5755 | Ant1 | 5700 | -46.08 | 3.71 | -42.37 | Peak    | 10   | Pass |
| NVNT | ac40 | 5755 | Ant1 | 5700 | -53.71 | 3.71 | -50.00 | Average | 10   | Pass |
| NVNT | ac40 | 5755 | Ant1 | 5720 | -29.97 | 3.71 | -26.26 | Peak    | 15.6 | Pass |
| NVNT | ac40 | 5755 | Ant1 | 5720 | -43.49 | 3.71 | -39.78 | Average | 15.6 | Pass |
| NVNT | ac40 | 5755 | Ant1 | 5725 | -26.97 | 3.71 | -23.26 | Peak    | 27   | Pass |
| NVNT | ac40 | 5755 | Ant1 | 5725 | -39.31 | 3.71 | -35.60 | Average | 27   | Pass |
| NVNT | ac40 | 5795 | Ant1 | 5850 | -46.9  | 3.71 | -43.19 | Peak    | 27   | Pass |
| NVNT | ac40 | 5795 | Ant1 | 5850 | -53.97 | 3.71 | -50.26 | Average | 27   | Pass |
| NVNT | ac40 | 5795 | Ant1 | 5855 | -47.78 | 3.71 | -44.07 | Peak    | 15.6 | Pass |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



|      |      |      |      |      |        |      |        |         |      |      |
|------|------|------|------|------|--------|------|--------|---------|------|------|
| NVNT | ac40 | 5795 | Ant1 | 5855 | -54.63 | 3.71 | -50.92 | Average | 15.6 | Pass |
| NVNT | ac40 | 5795 | Ant1 | 5875 | -50.29 | 3.71 | -46.58 | Peak    | 10   | Pass |
| NVNT | ac40 | 5795 | Ant1 | 5875 | -56.08 | 3.71 | -52.37 | Average | 10   | Pass |
| NVNT | ac40 | 5795 | Ant1 | 5925 | -48.62 | 3.71 | -44.91 | Peak    | -27  | Pass |
| NVNT | ac40 | 5795 | Ant1 | 5925 | -56.55 | 3.71 | -52.84 | Average | -27  | Pass |
| NVNT | ac80 | 5775 | Ant1 | 5850 | -39.19 | 3.71 | -35.48 | Peak    | 27   | Pass |
| NVNT | ac80 | 5775 | Ant1 | 5850 | -46.95 | 3.71 | -43.24 | Average | 27   | Pass |
| NVNT | ac80 | 5775 | Ant1 | 5855 | -39.64 | 3.71 | -35.93 | Peak    | 15.6 | Pass |
| NVNT | ac80 | 5775 | Ant1 | 5855 | -47.66 | 3.71 | -43.95 | Average | 15.6 | Pass |
| NVNT | ac80 | 5775 | Ant1 | 5875 | -45.97 | 3.71 | -42.26 | Peak    | 10   | Pass |
| NVNT | ac80 | 5775 | Ant1 | 5875 | -51.84 | 3.71 | -48.13 | Average | 10   | Pass |
| NVNT | ac80 | 5775 | Ant1 | 5925 | -48.92 | 3.71 | -45.21 | Peak    | -27  | Pass |
| NVNT | ac80 | 5775 | Ant1 | 5925 | -55.89 | 3.71 | -52.18 | Average | -27  | Pass |
| NVNT | ac80 | 5775 | Ant1 | 5650 | -49.23 | 3.71 | -45.52 | Peak    | -27  | Pass |
| NVNT | ac80 | 5775 | Ant1 | 5650 | -55.6  | 3.71 | -51.89 | Average | -27  | Pass |
| NVNT | ac80 | 5775 | Ant1 | 5700 | -42.5  | 3.71 | -38.79 | Peak    | 10   | Pass |
| NVNT | ac80 | 5775 | Ant1 | 5700 | -49.33 | 3.71 | -45.62 | Average | 10   | Pass |
| NVNT | ac80 | 5775 | Ant1 | 5720 | -38    | 3.71 | -34.29 | Peak    | 15.6 | Pass |
| NVNT | ac80 | 5775 | Ant1 | 5720 | -46.44 | 3.71 | -42.73 | Average | 15.6 | Pass |
| NVNT | ac80 | 5775 | Ant1 | 5725 | -35.9  | 3.71 | -32.19 | Peak    | 27   | Pass |
| NVNT | ac80 | 5775 | Ant1 | 5725 | -43.91 | 3.71 | -40.20 | Average | 27   | Pass |




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

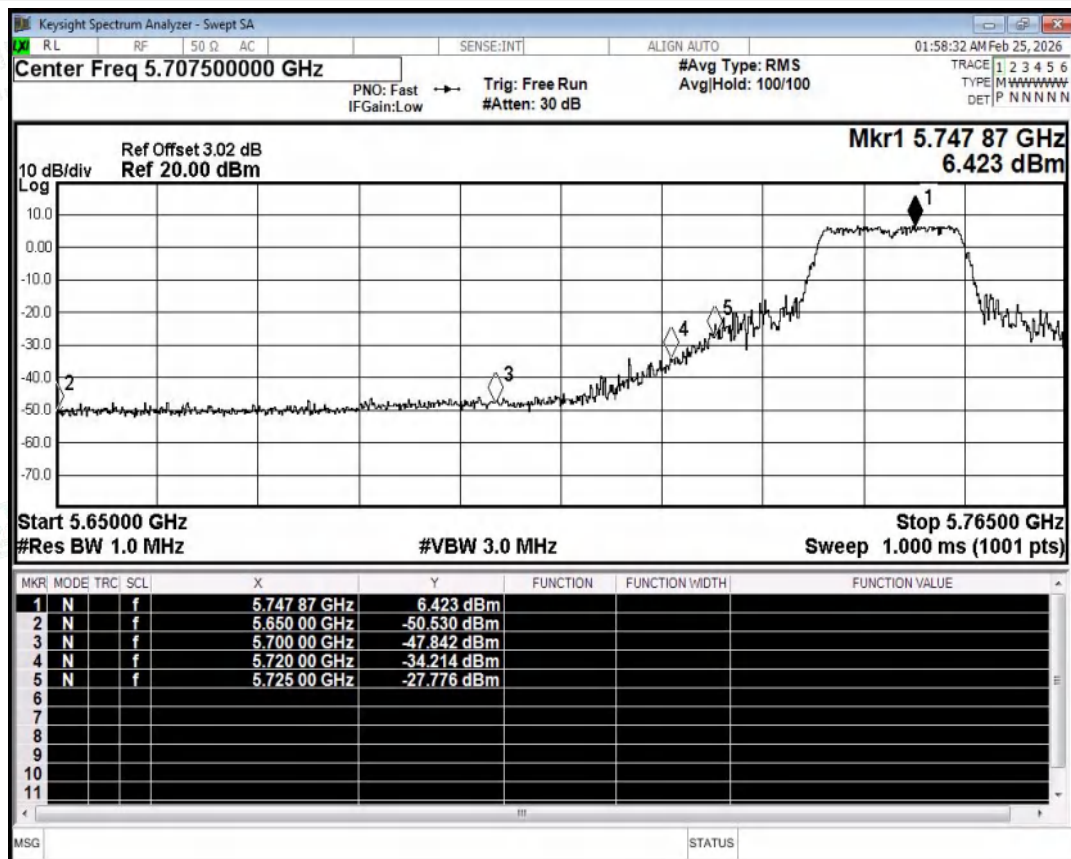

Restrict Band NVNT a 5745MHz Ant1 Peak




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

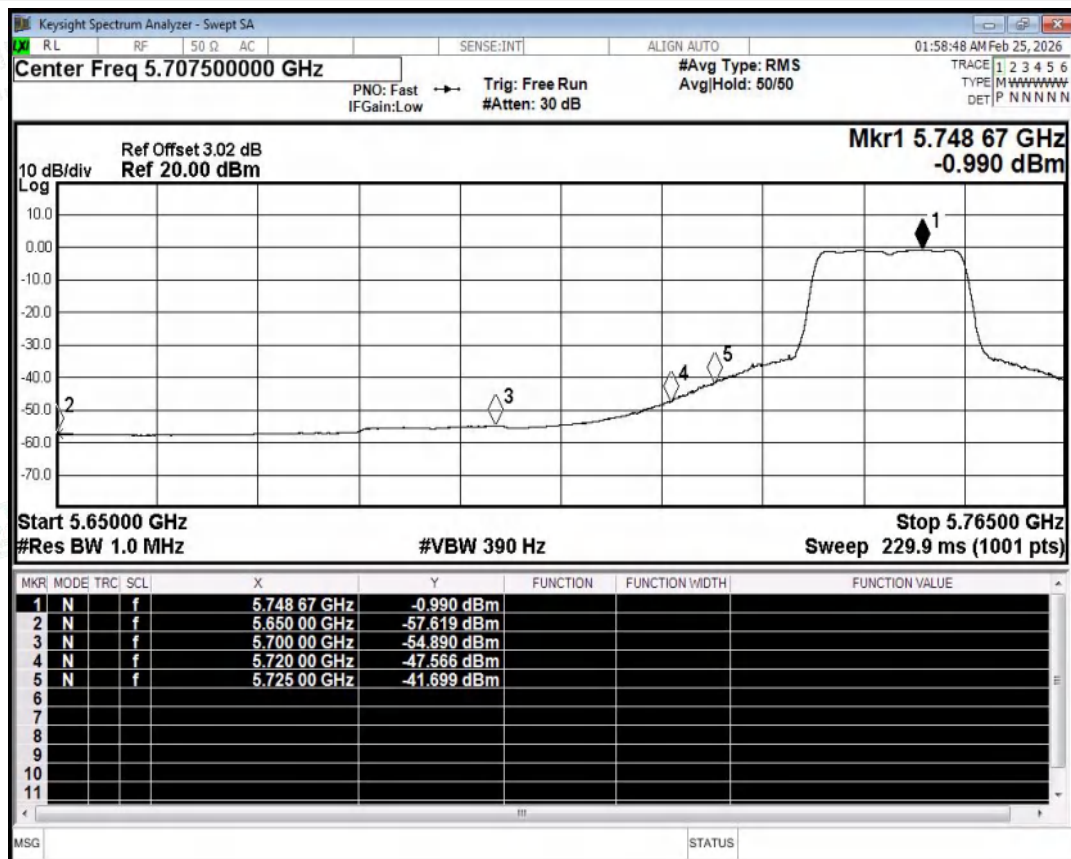

Restrict Band NVNT a 5745MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

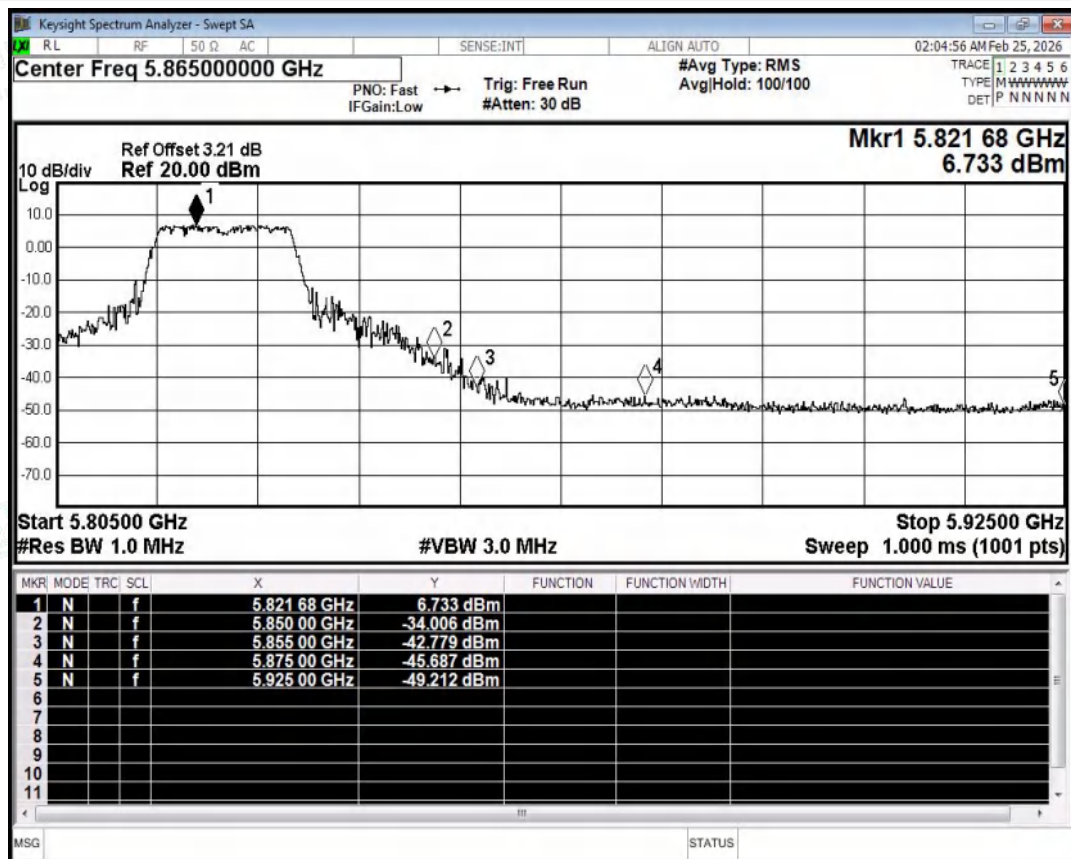

Restrict Band NVNT a 5825MHz Ant1 Peak




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

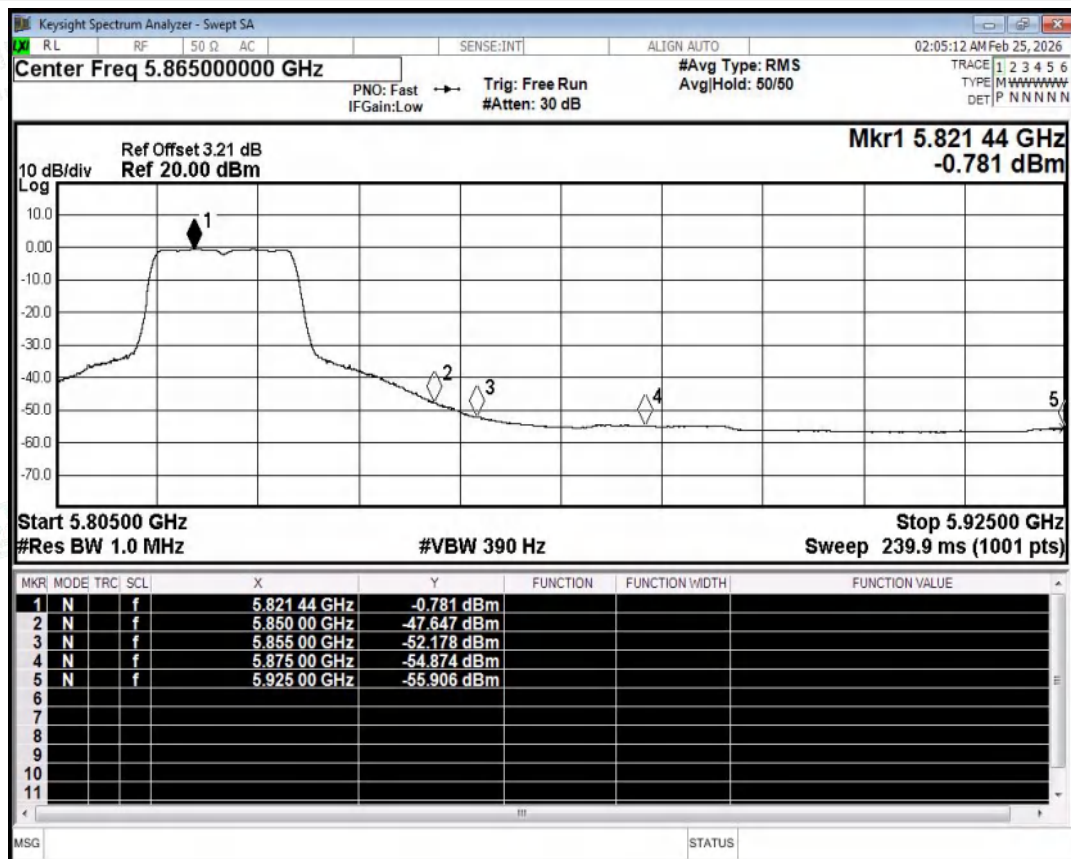

Restrict Band NVNT a 5825MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

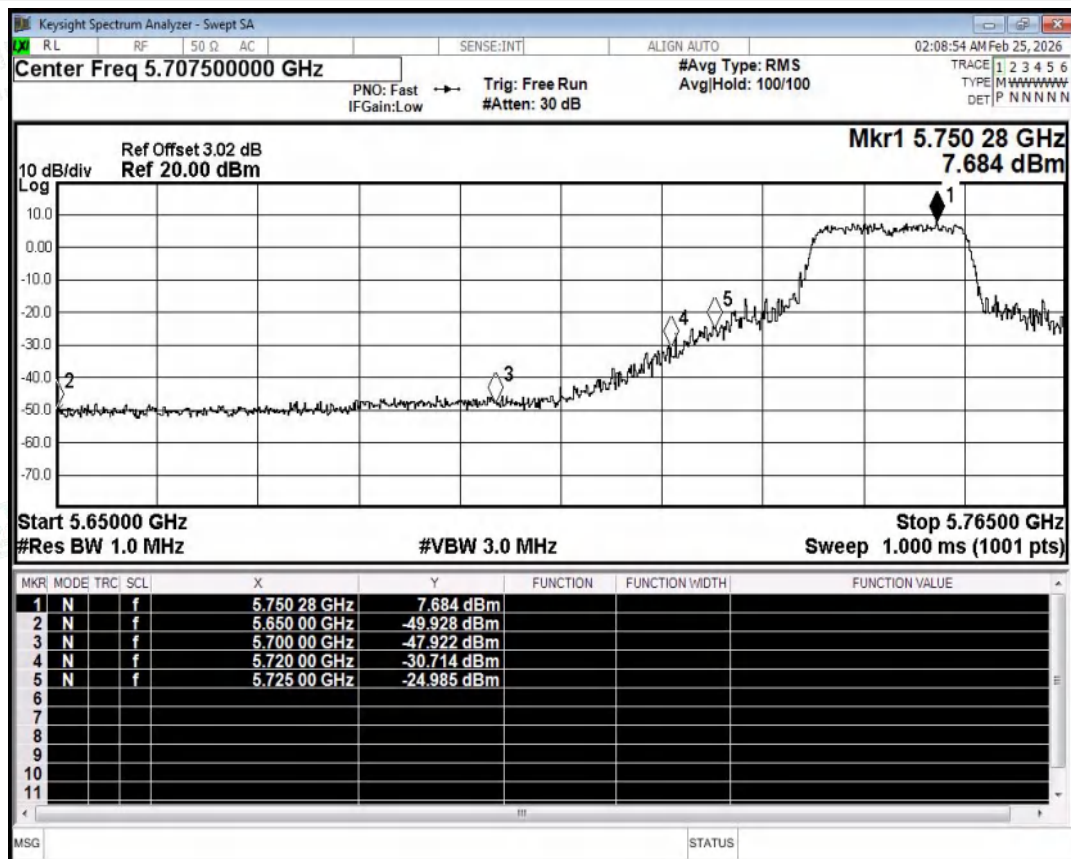

Restrict Band NVNT n20 5745MHz Ant1 Peak




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

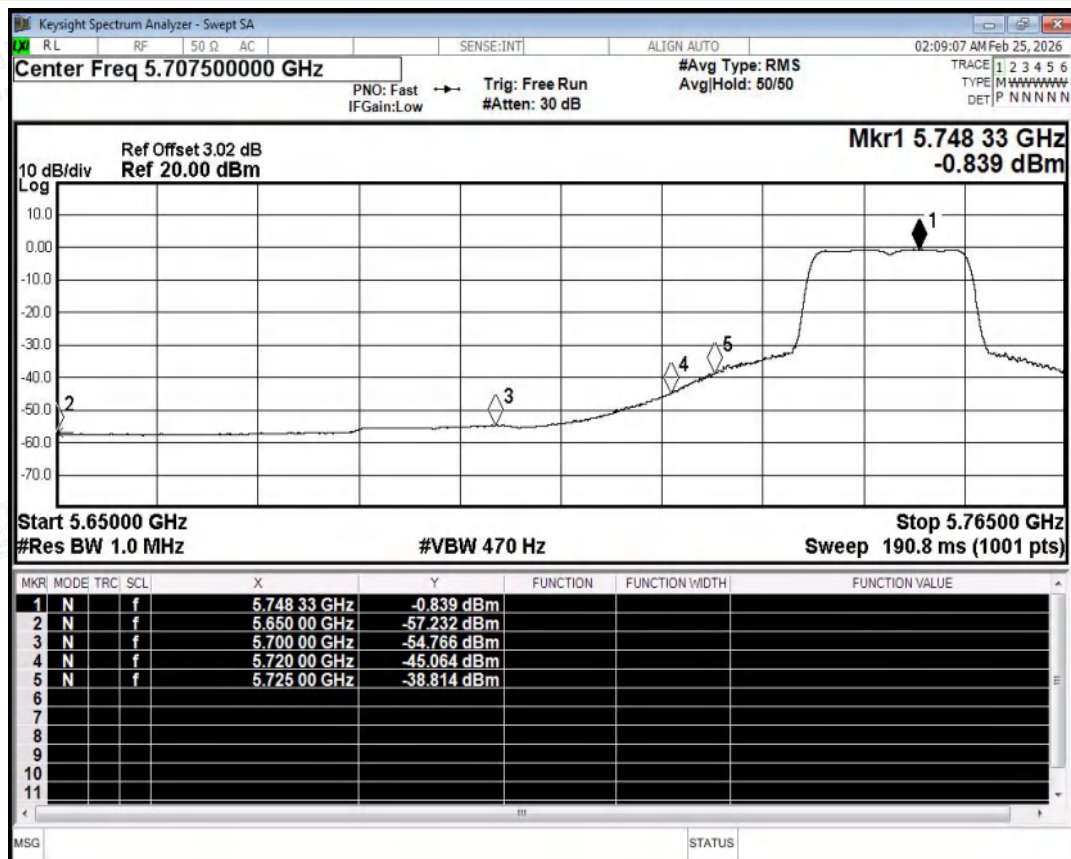

Restrict Band NVNT n20 5745MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

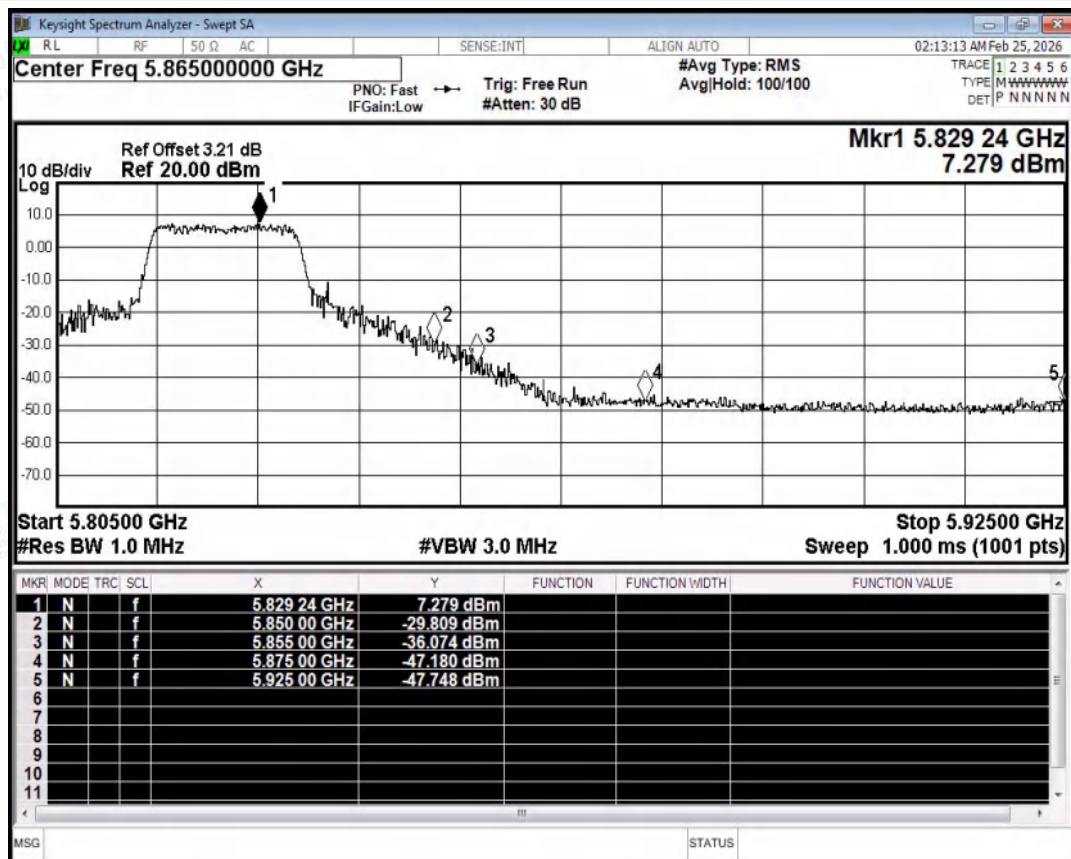

Restrict Band NVNT n20 5825MHz Ant1 Peak




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

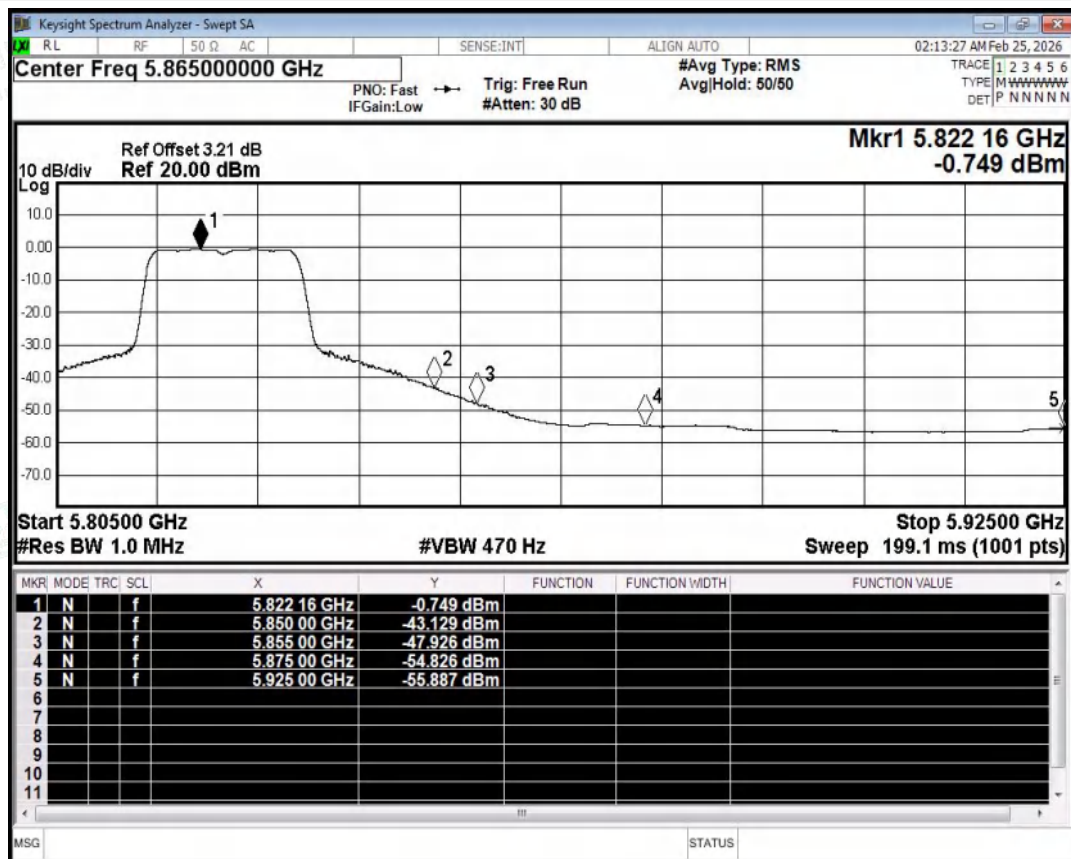

Restrict Band NVNT n20 5825MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

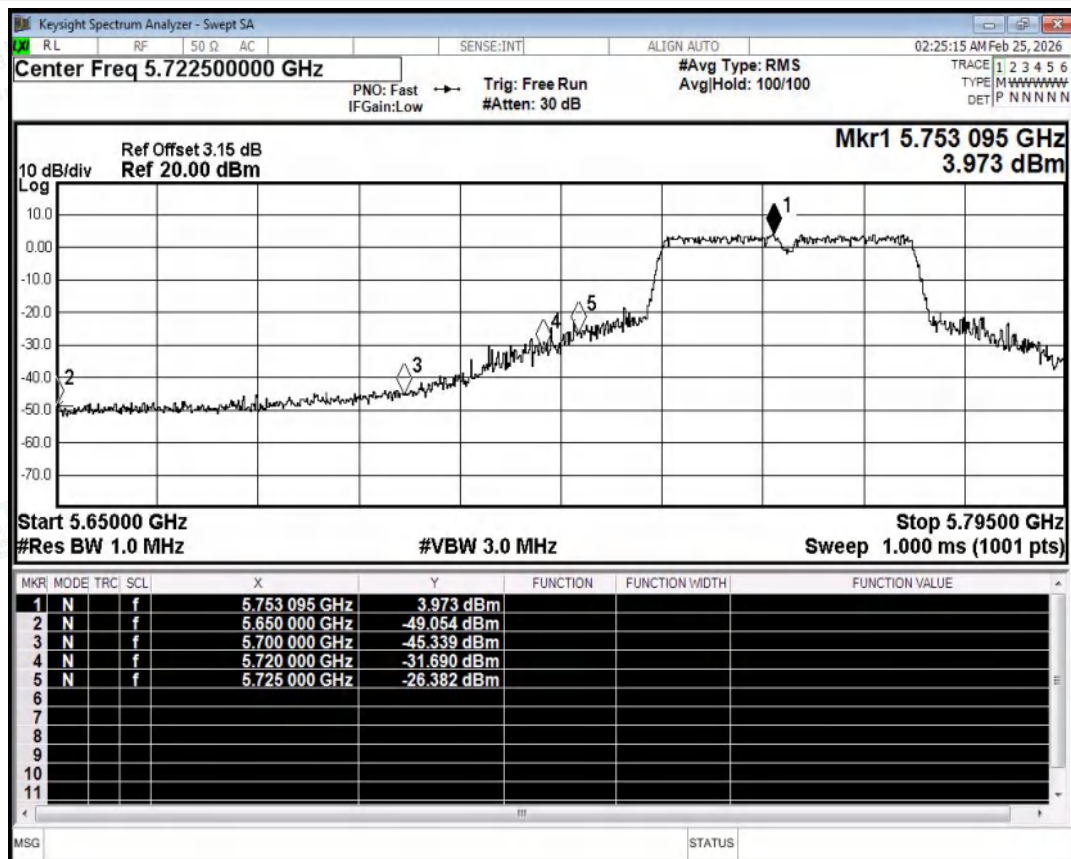

Restrict Band NVNT n40 5755MHz Ant1 Peak




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

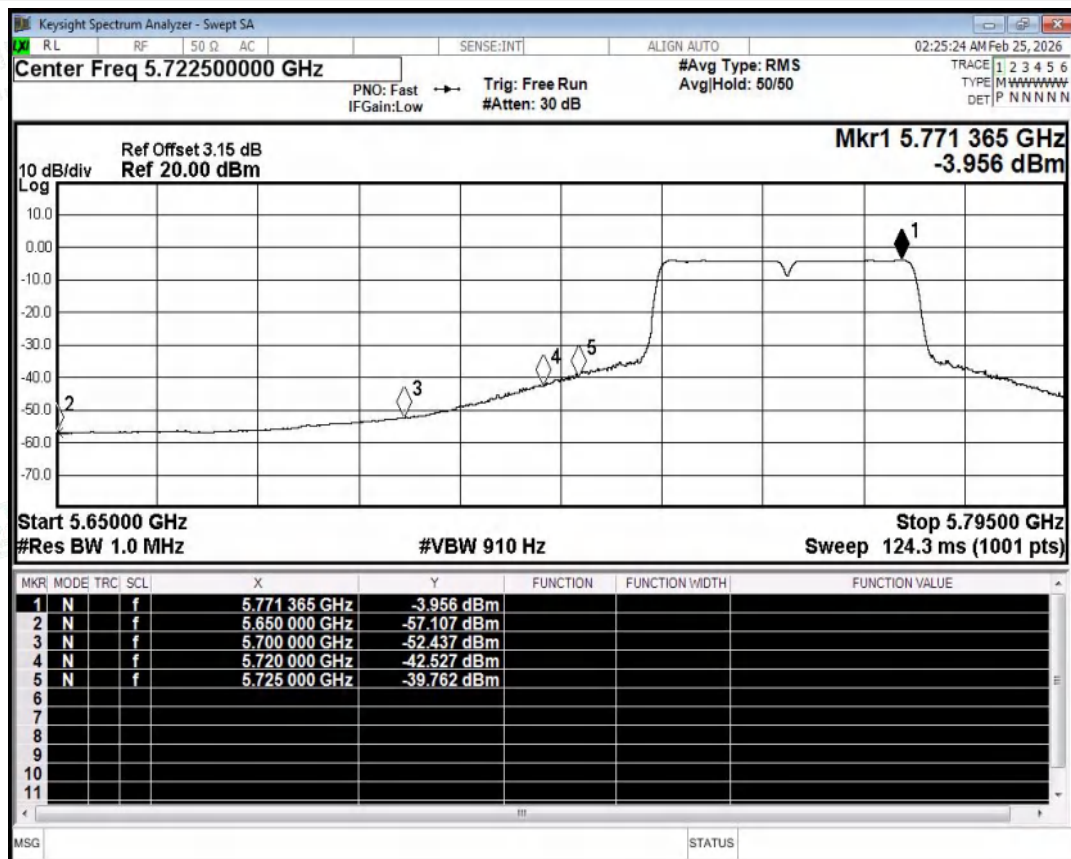

Restrict Band NVNT n40 5755MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

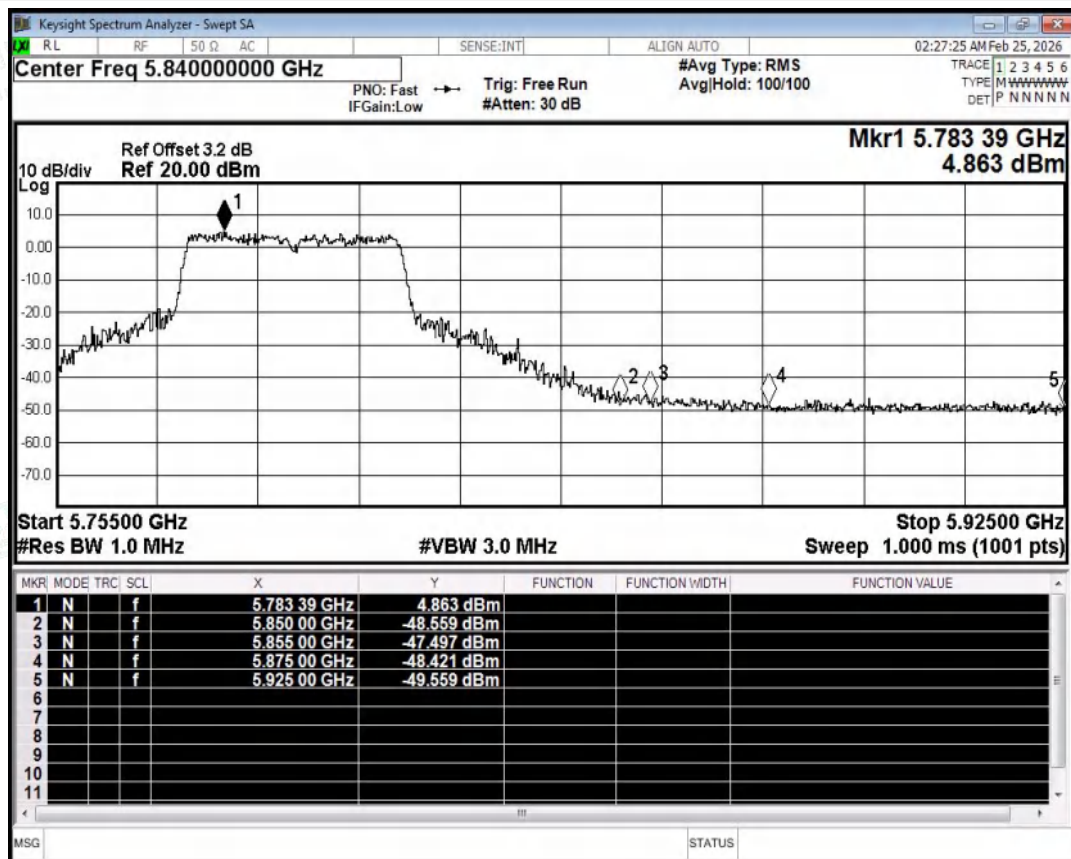

Restrict Band NVNT n40 5795MHz Ant1 Peak




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

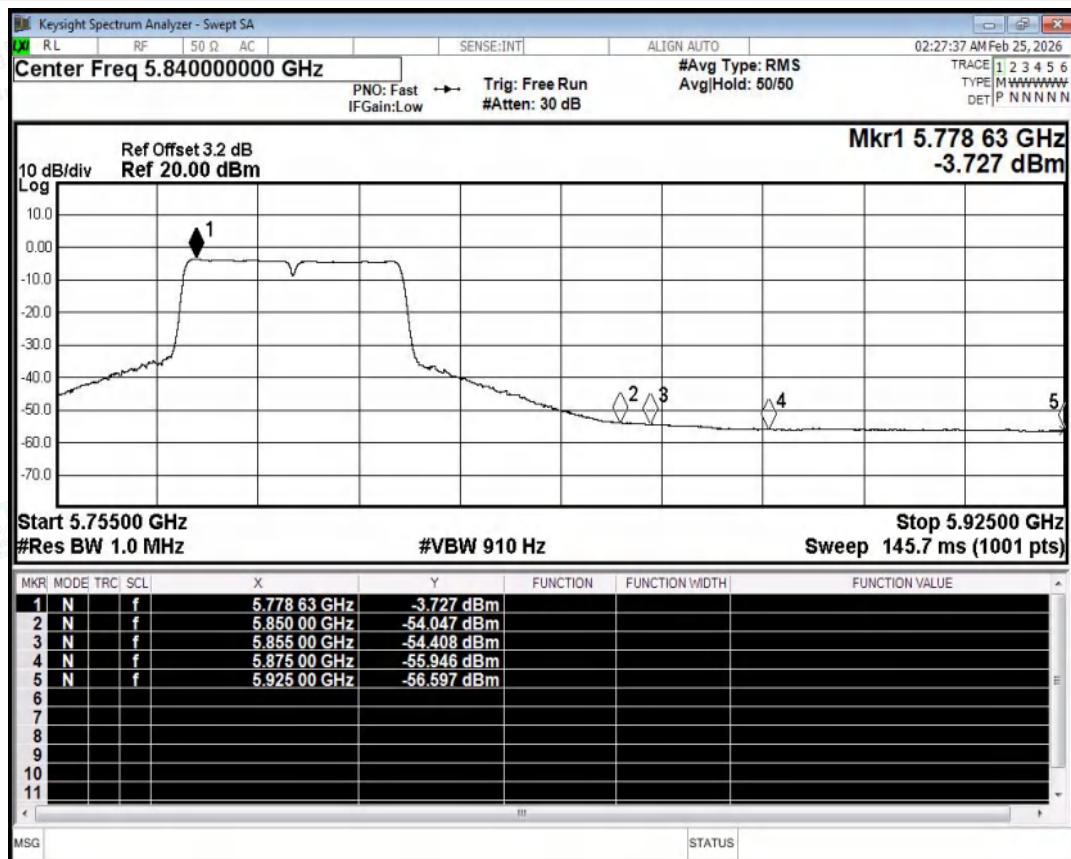

Restrict Band NVNT n40 5795MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

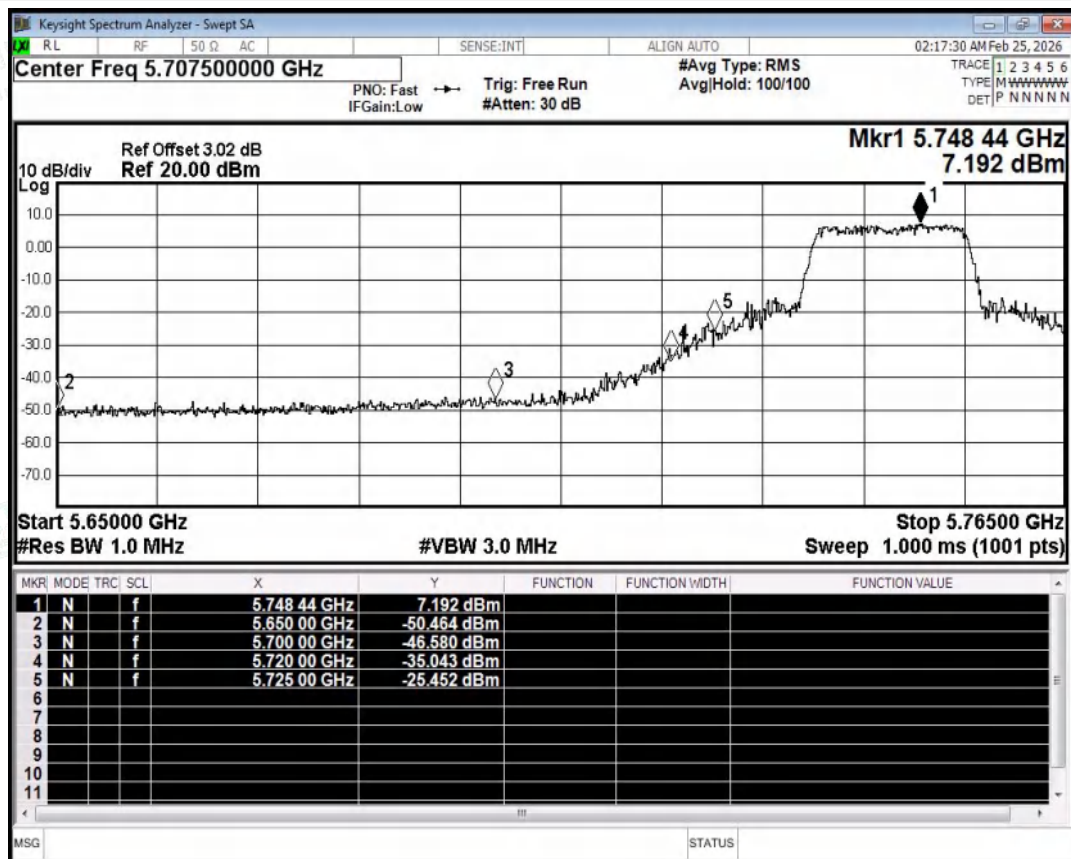

Restrict Band NVNT ac20 5745MHz Ant1 Peak




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

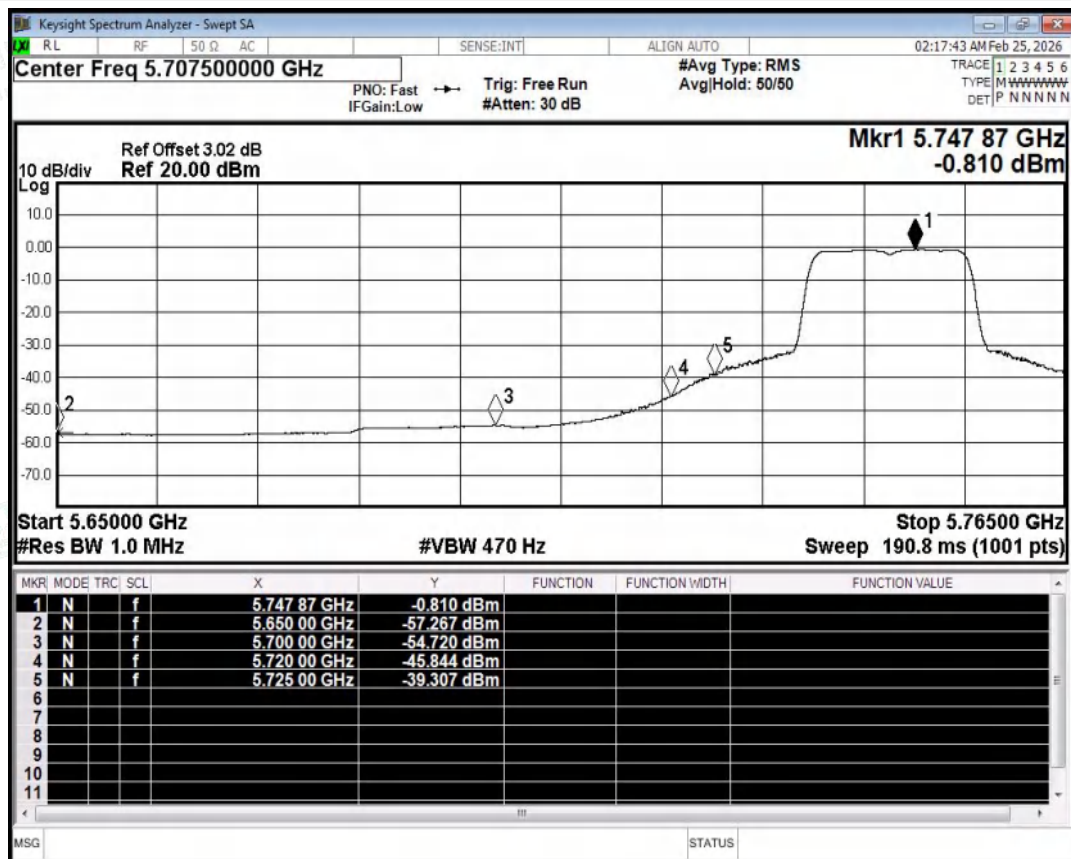

Restrict Band NVNT ac20 5745MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

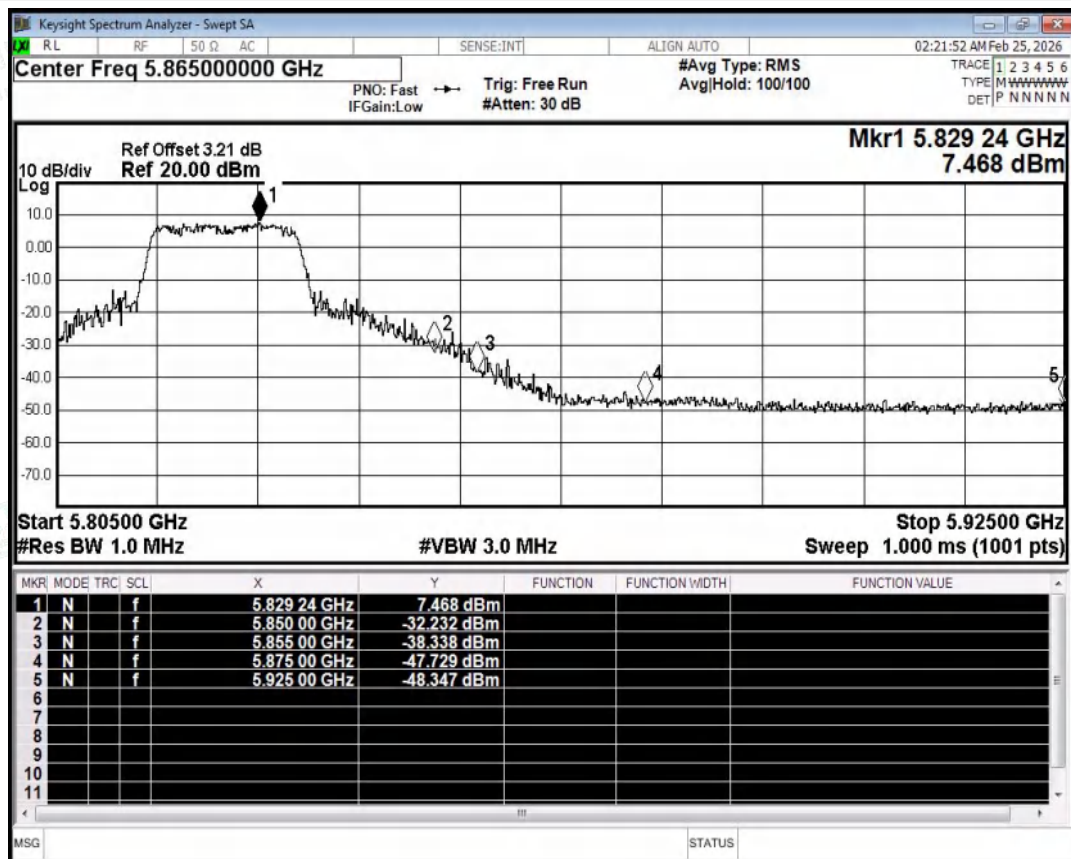

Restrict Band NVNT ac20 5825MHz Ant1 Peak




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

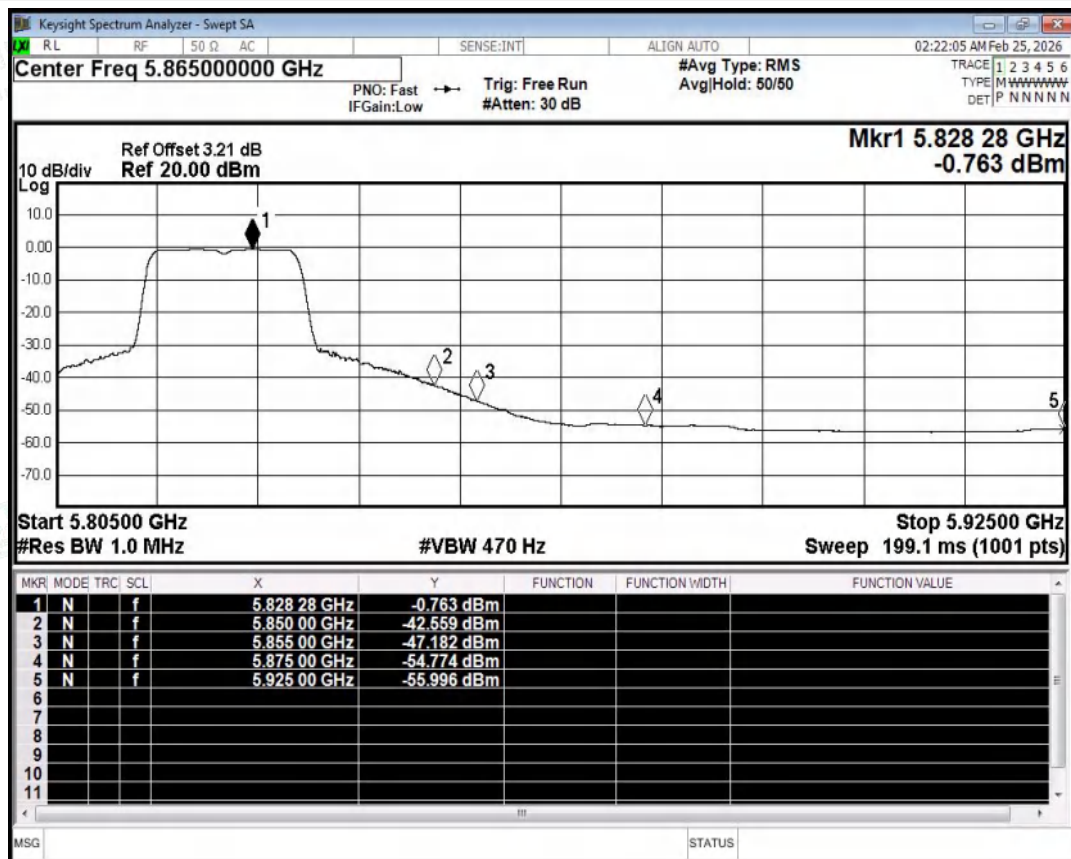

Restrict Band NVNT ac20 5825MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

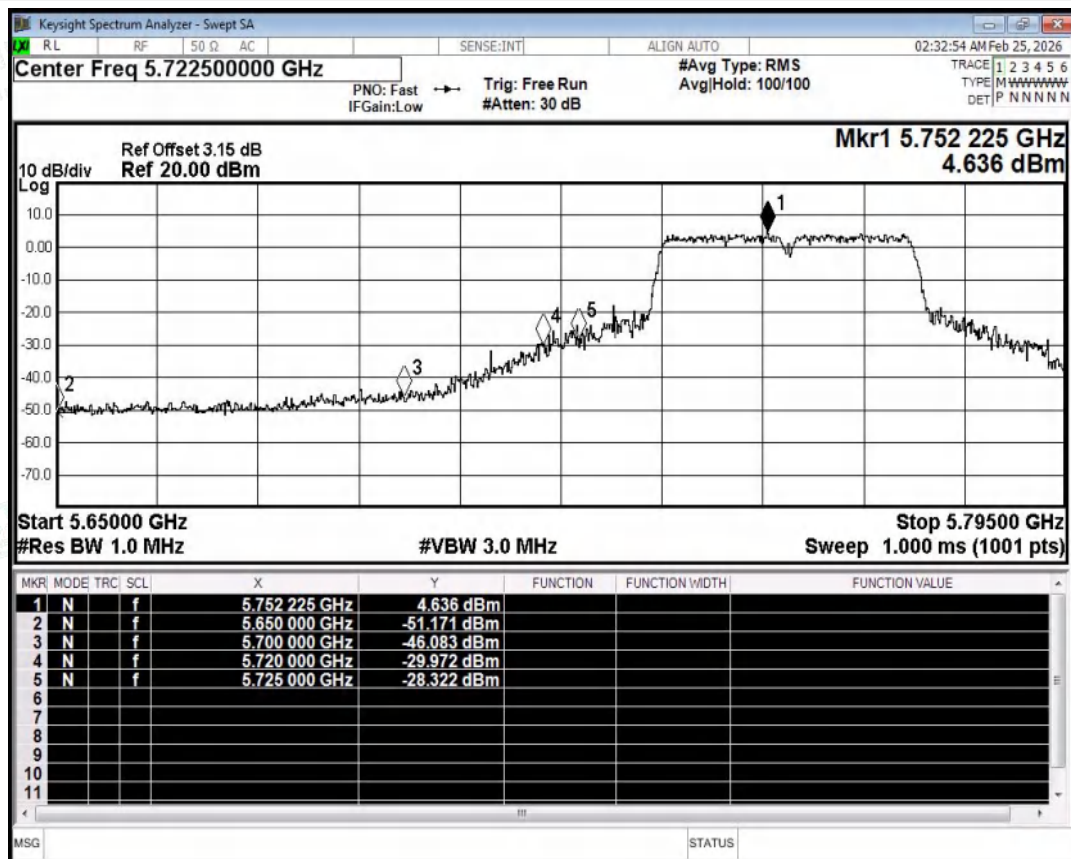

Restrict Band NVNT ac40 5755MHz Ant1 Peak




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

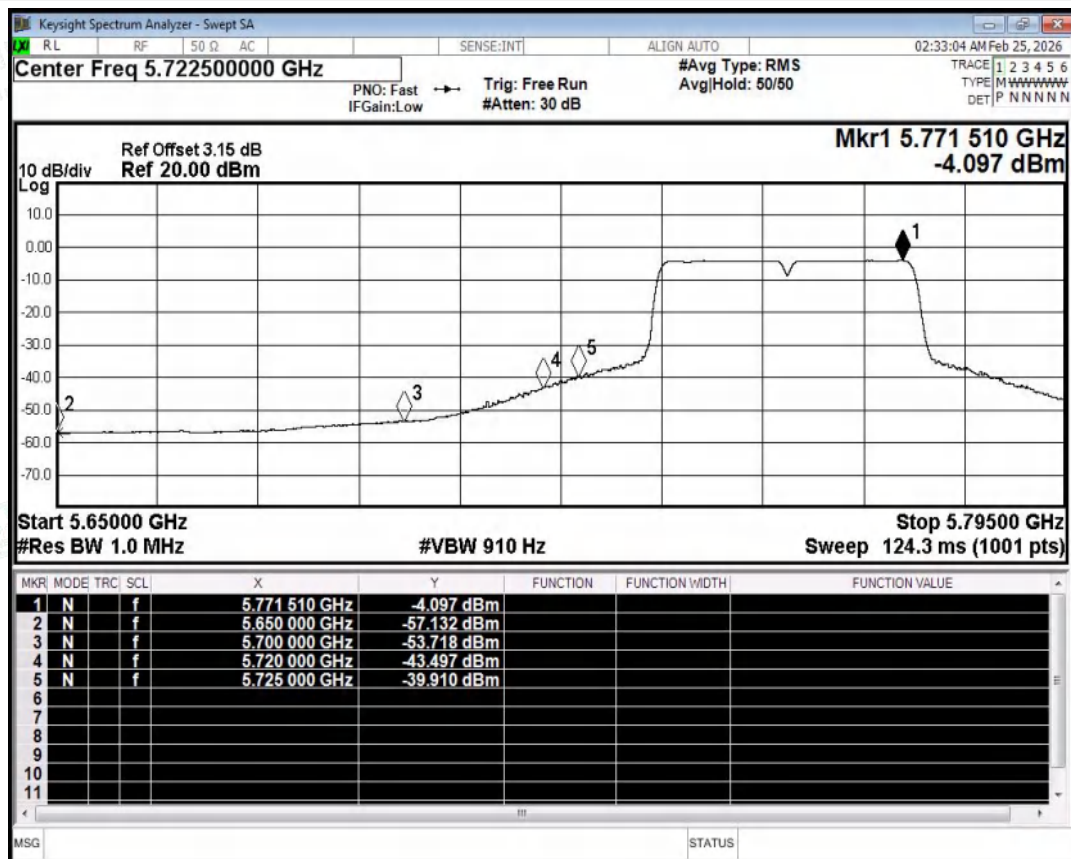

Restrict Band NVNT ac40 5755MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

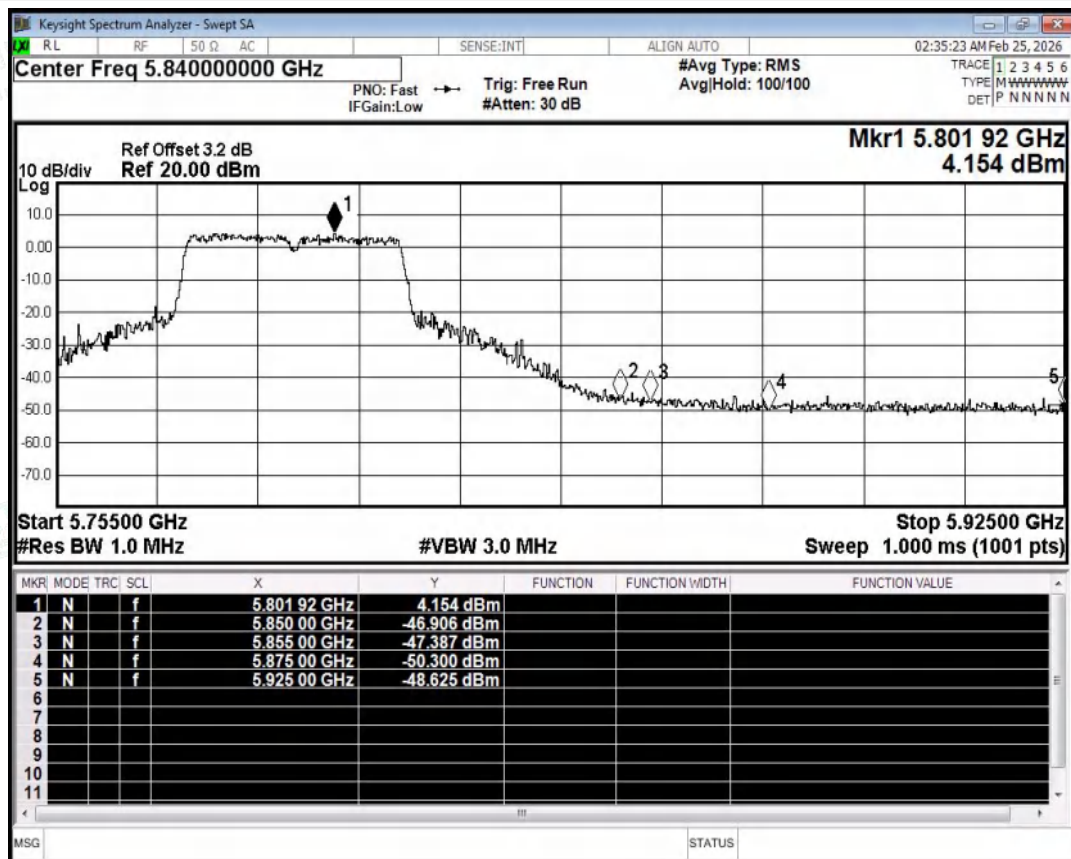

Restrict Band NVNT ac40 5795MHz Ant1 Peak




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

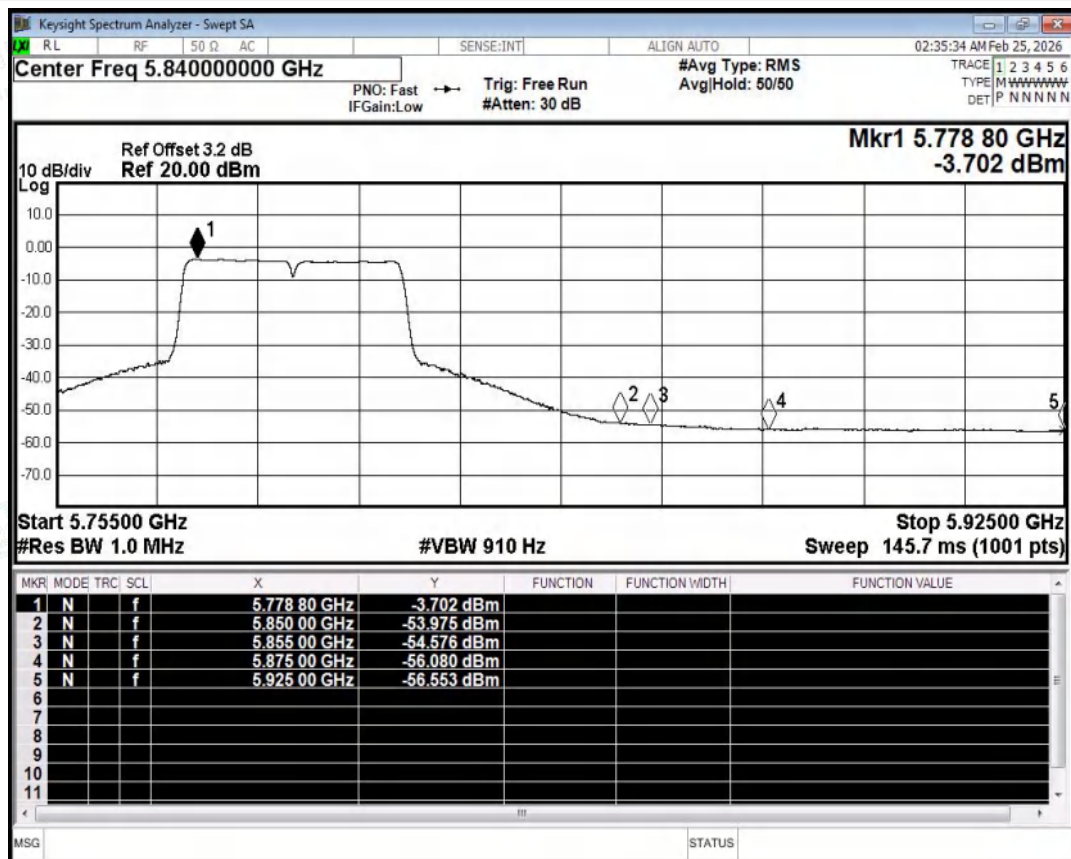

Restrict Band NVNT ac40 5795MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

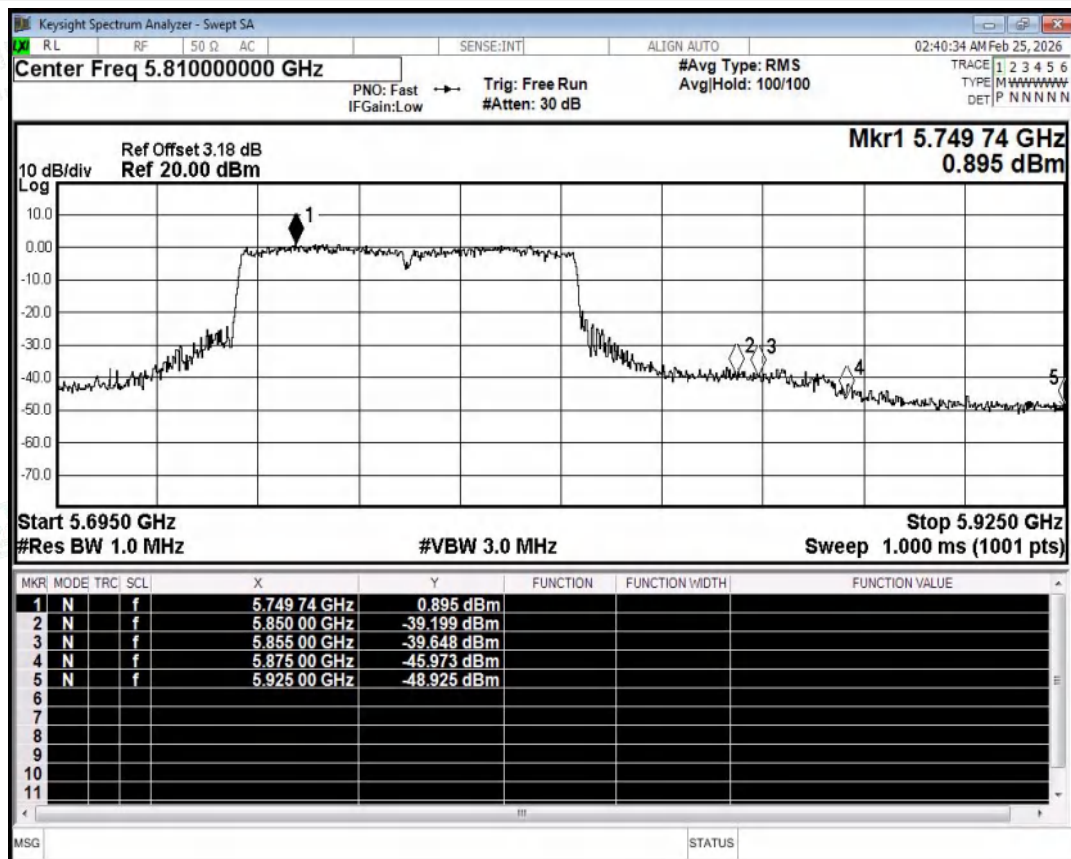

Restrict Band NVNT ac80 5775MHz Ant1 Peak




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

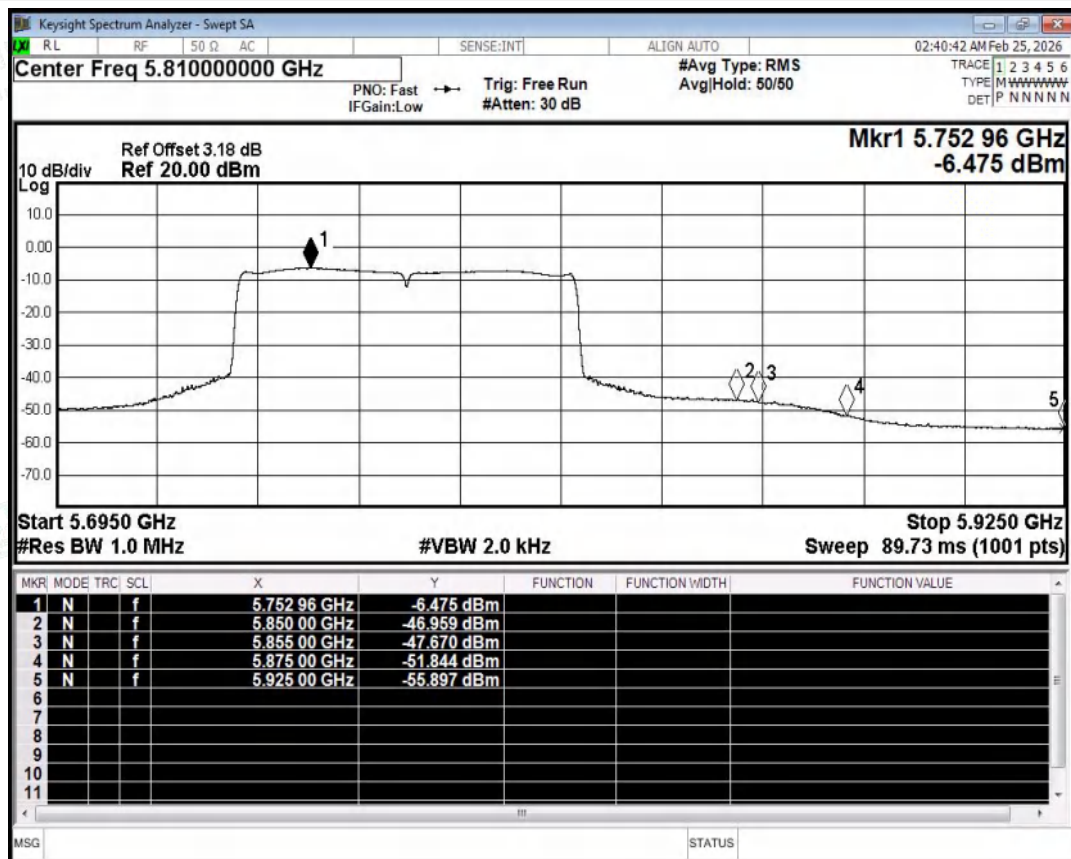

Restrict Band NVNT ac80 5775MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

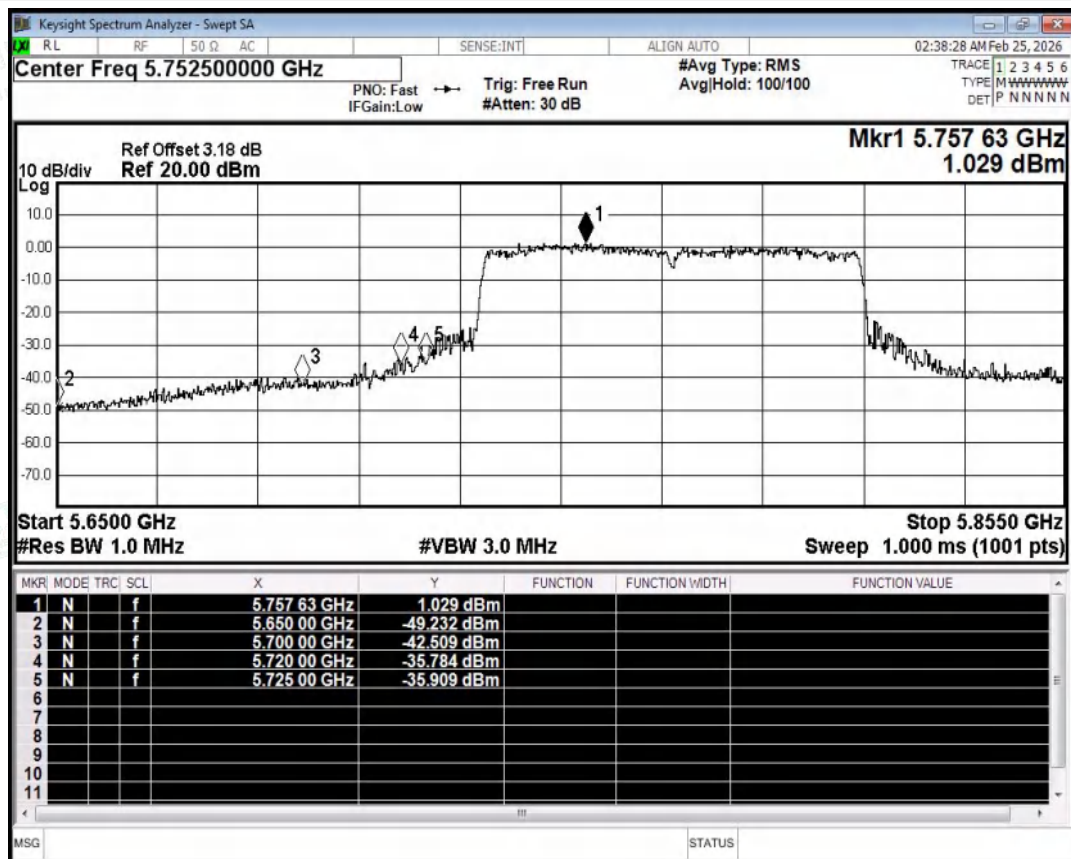

Restrict Band NVNT ac80 5775MHz Ant1 Peak




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

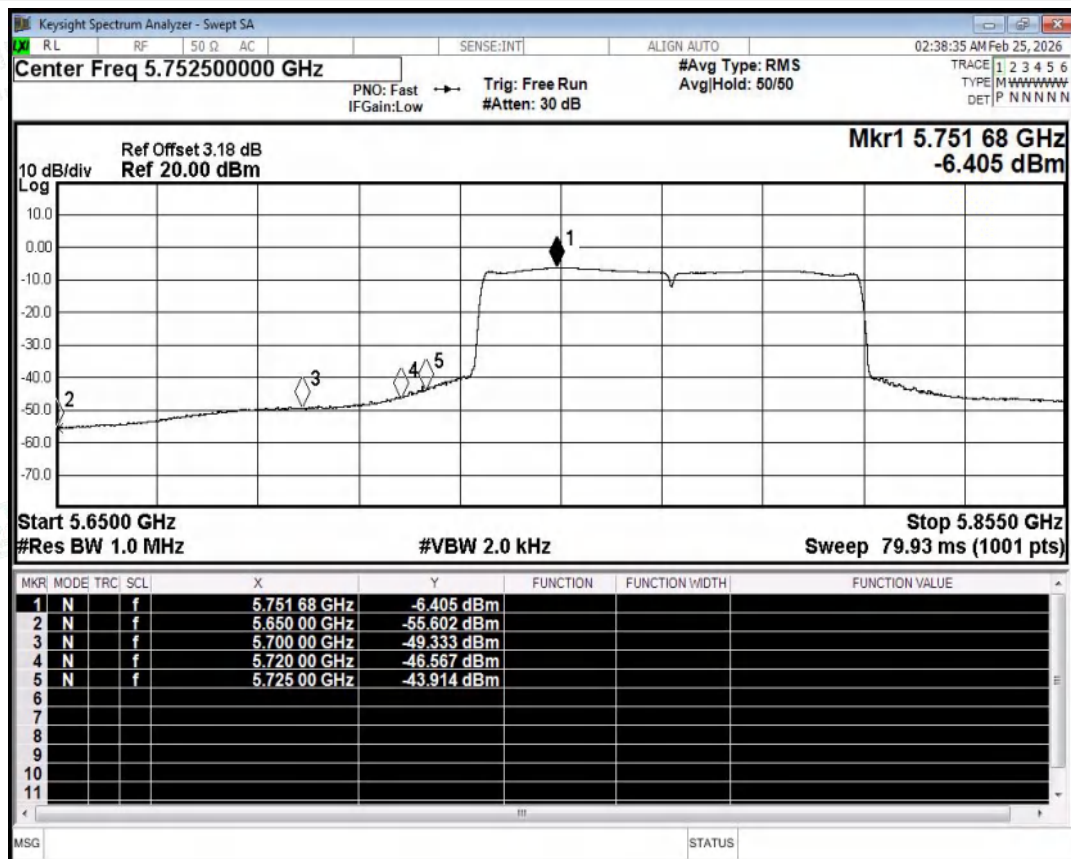

Restrict Band NVNT ac80 5775MHz Ant1 Average



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



## E.5 Frequency Stability

| Condition | Mode | Frequency (MHz) | Antenna | Measured Frequency (MHz) | Frequency Error (Hz) | Deviation (ppm) | Limit (ppm) | Verdict |
|-----------|------|-----------------|---------|--------------------------|----------------------|-----------------|-------------|---------|
| NVNT      | a    | 5745            | Ant1    | 5744.98                  | -20000               | -3.48           | 25          | Pass    |
| NVNT      | a    | 5785            | Ant1    | 5784.98                  | -20000               | -3.46           | 25          | Pass    |
| NVNT      | a    | 5825            | Ant1    | 5824.98                  | -20000               | -3.43           | 25          | Pass    |
| NVNT      | n20  | 5745            | Ant1    | 5744.98                  | -20000               | -3.48           | 25          | Pass    |
| NVNT      | n20  | 5785            | Ant1    | 5784.98                  | -20000               | -3.46           | 25          | Pass    |
| NVNT      | n20  | 5825            | Ant1    | 5824.96                  | -40000               | -6.87           | 25          | Pass    |
| NVNT      | n40  | 5755            | Ant1    | 5754.96                  | -40000               | -6.95           | 25          | Pass    |
| NVNT      | n40  | 5795            | Ant1    | 5794.96                  | -40000               | -6.9            | 25          | Pass    |
| NVNT      | ac20 | 5745            | Ant1    | 5744.98                  | -20000               | -3.48           | 25          | Pass    |
| NVNT      | ac20 | 5785            | Ant1    | 5784.98                  | -20000               | -3.46           | 25          | Pass    |
| NVNT      | ac20 | 5825            | Ant1    | 5824.96                  | -40000               | -6.87           | 25          | Pass    |
| NVNT      | ac40 | 5755            | Ant1    | 5755                     | 0                    | 0               | 25          | Pass    |
| NVNT      | ac40 | 5795            | Ant1    | 5794.96                  | -40000               | -6.9            | 25          | Pass    |
| NVNT      | ac80 | 5775            | Ant1    | 5775                     | 0                    | 0               | 25          | Pass    |




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

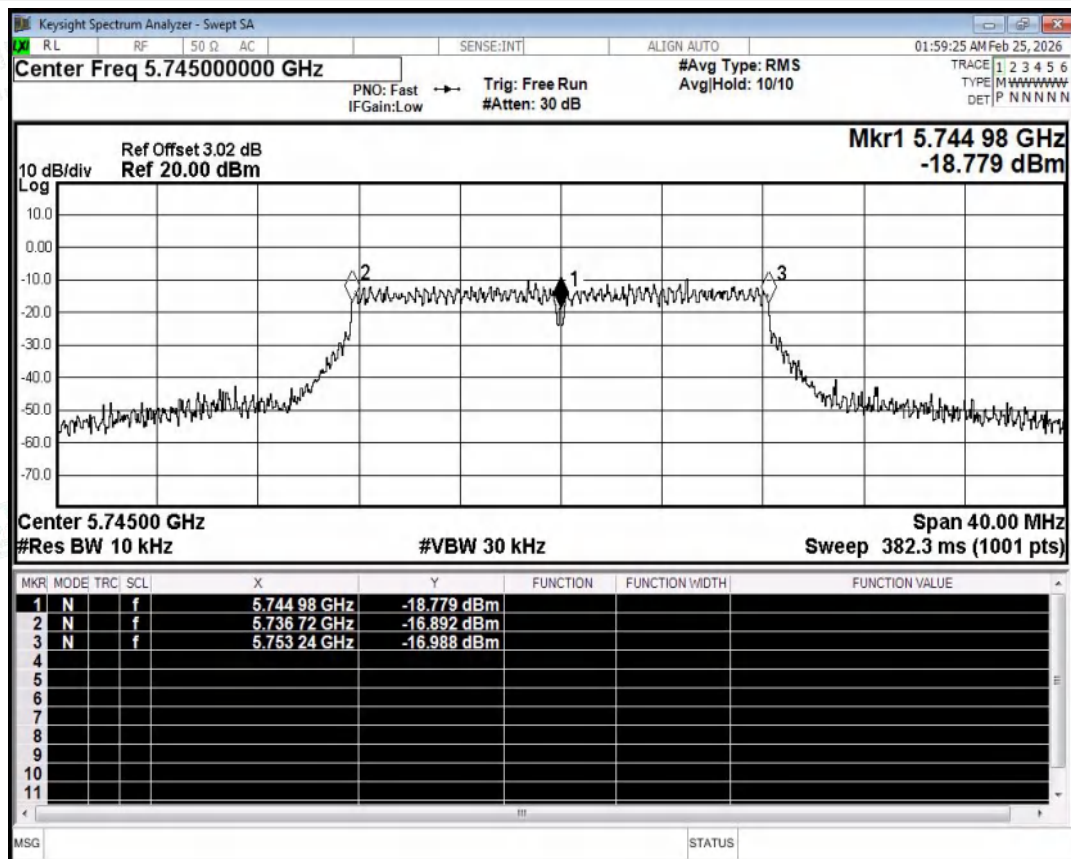

Freq. Stability NVNT a 5745MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

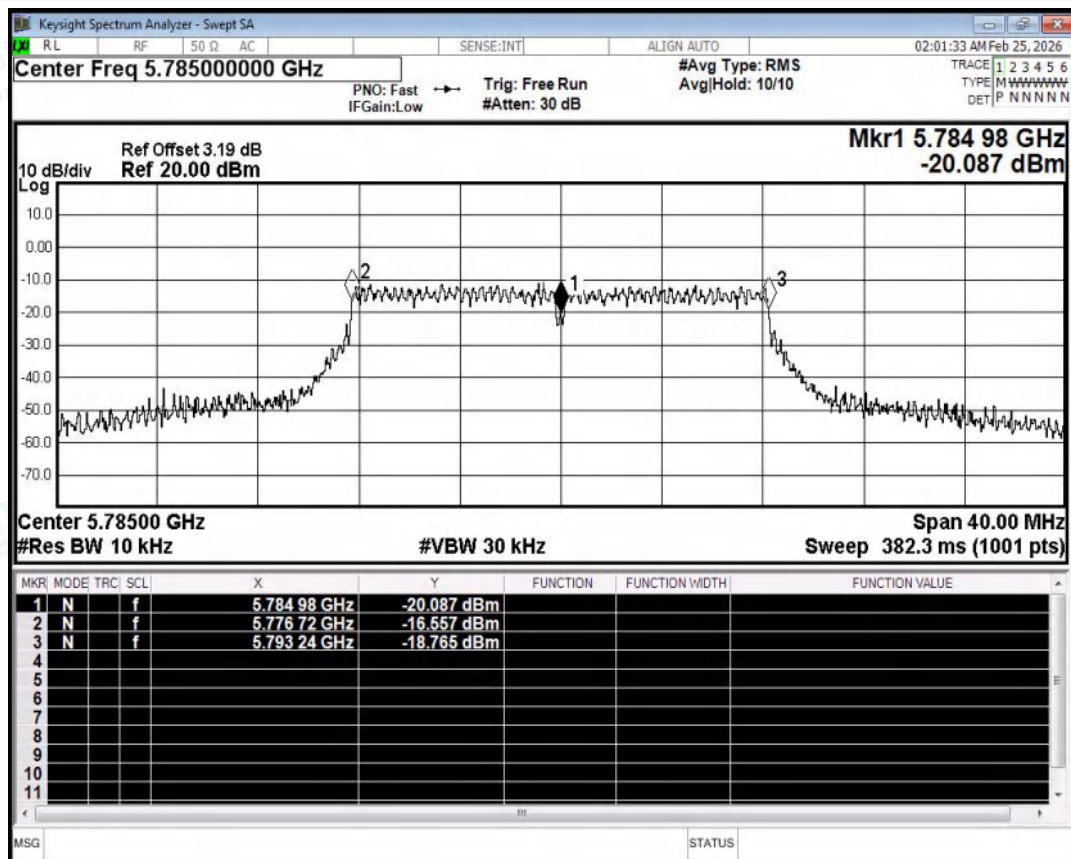

Freq. Stability NVNT a 5785MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

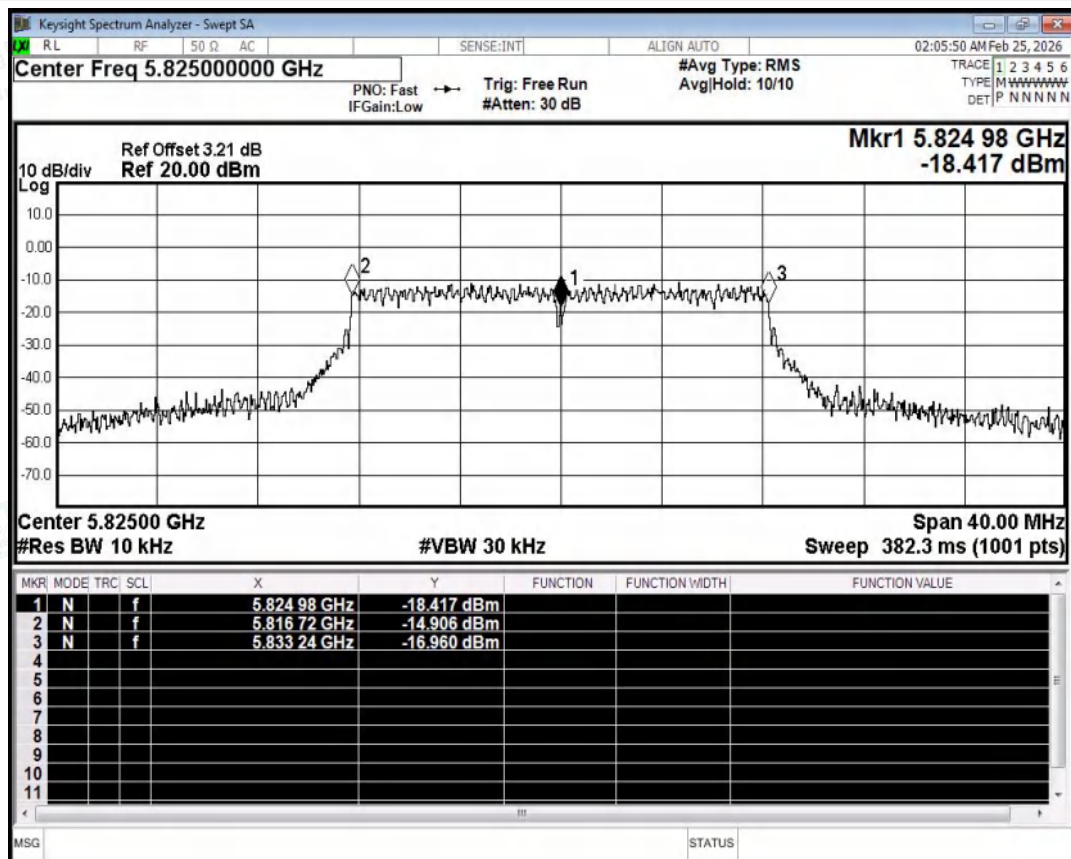

Freq. Stability NVNT a 5825MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

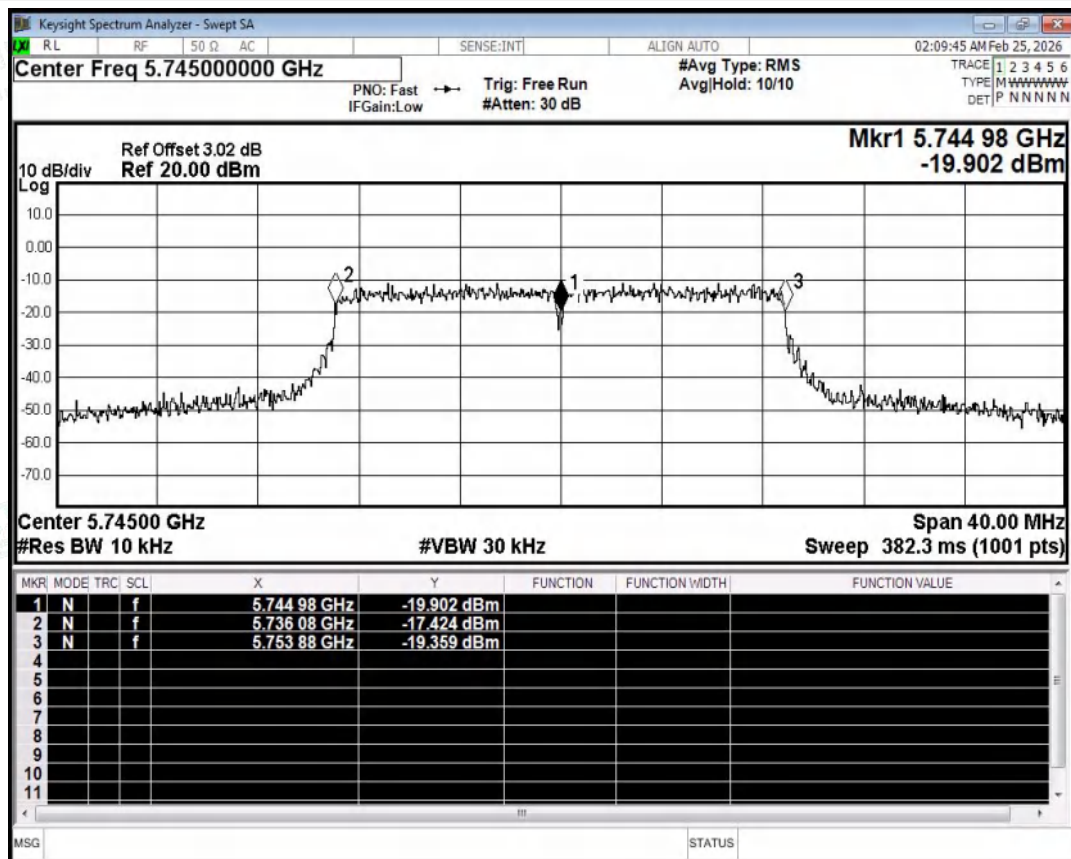

Freq. Stability NVNT n20 5745MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

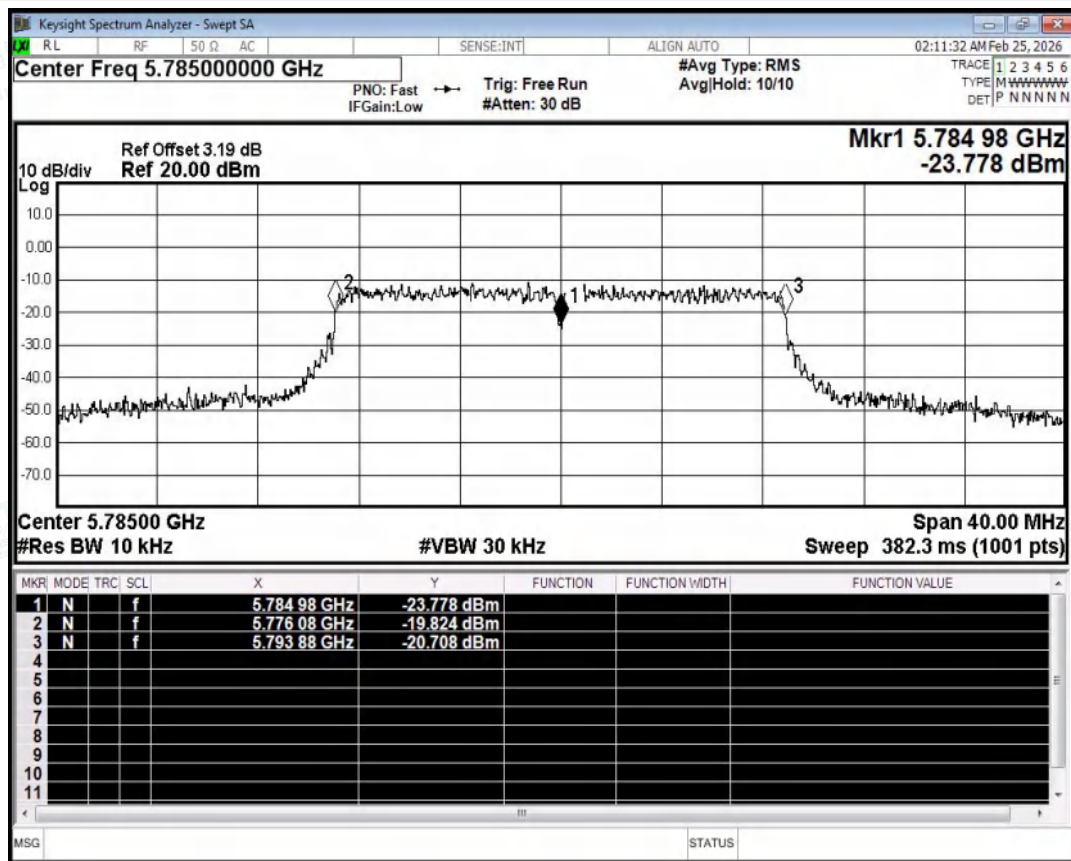

Freq. Stability NVNT n20 5785MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

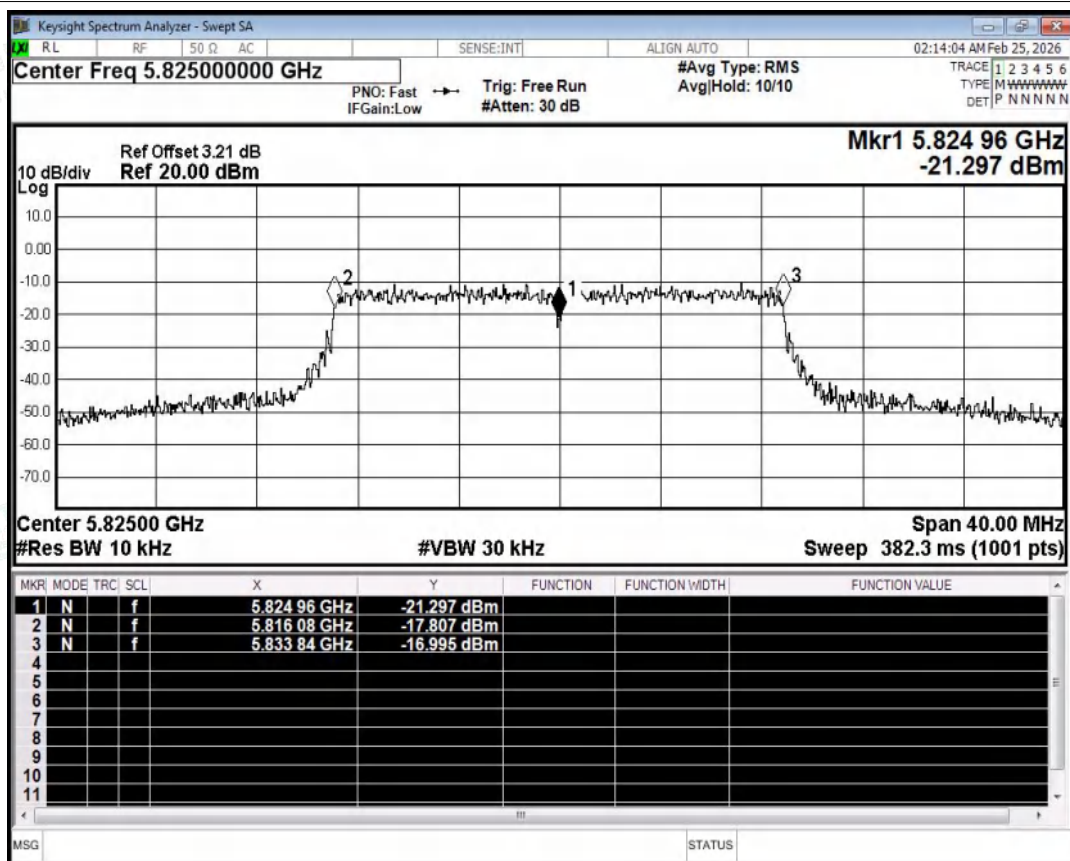

Freq. Stability NVNT n20 5825MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

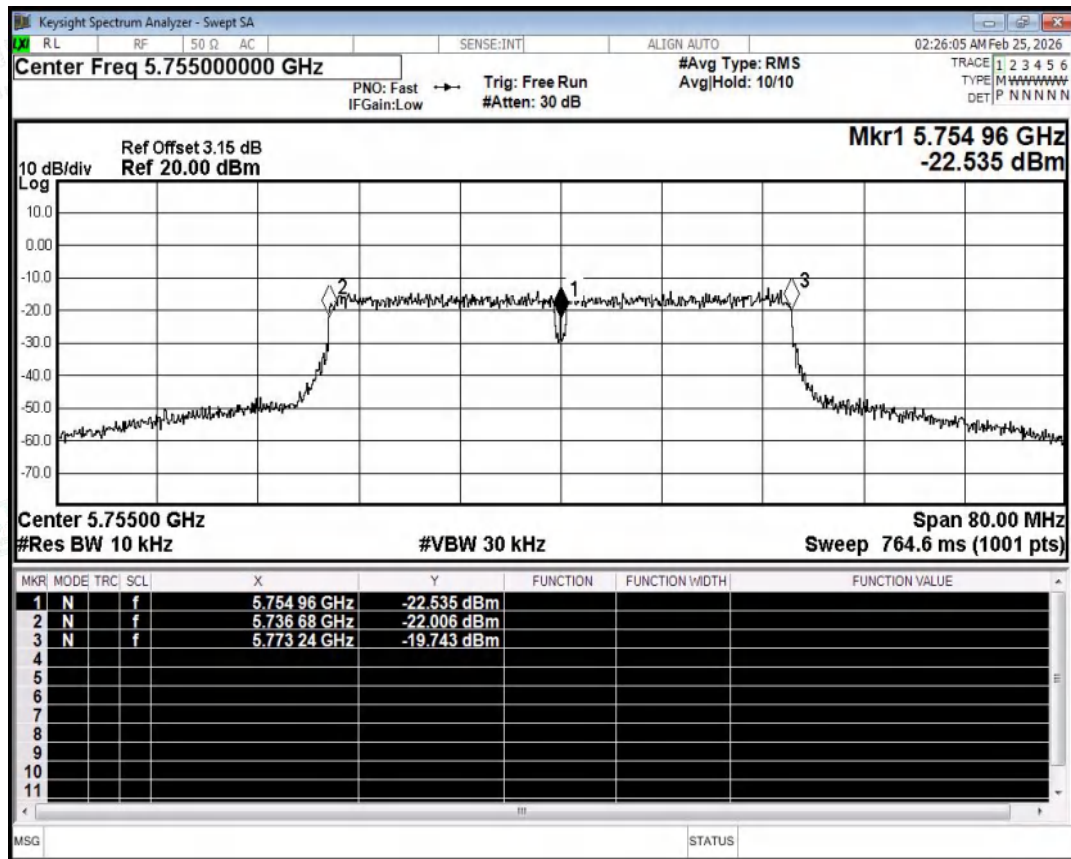

Freq. Stability NVNT n40 5755MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

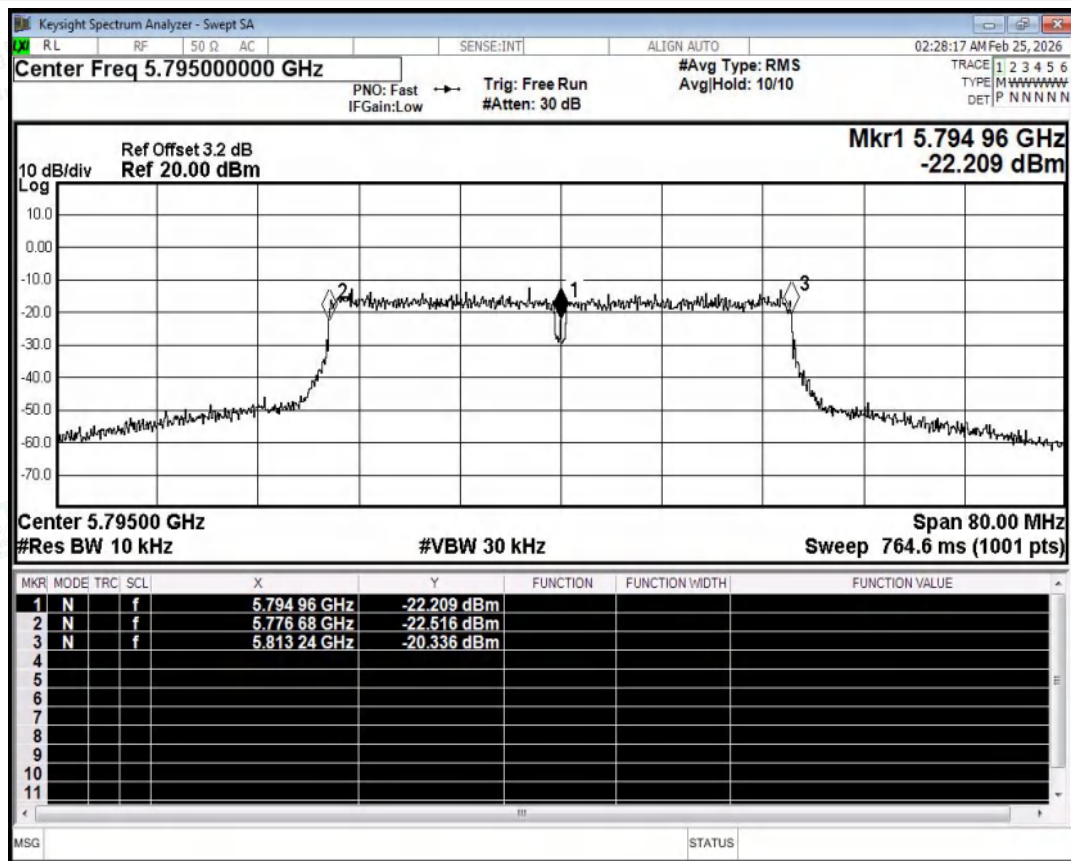

Freq. Stability NVNT n40 5795MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

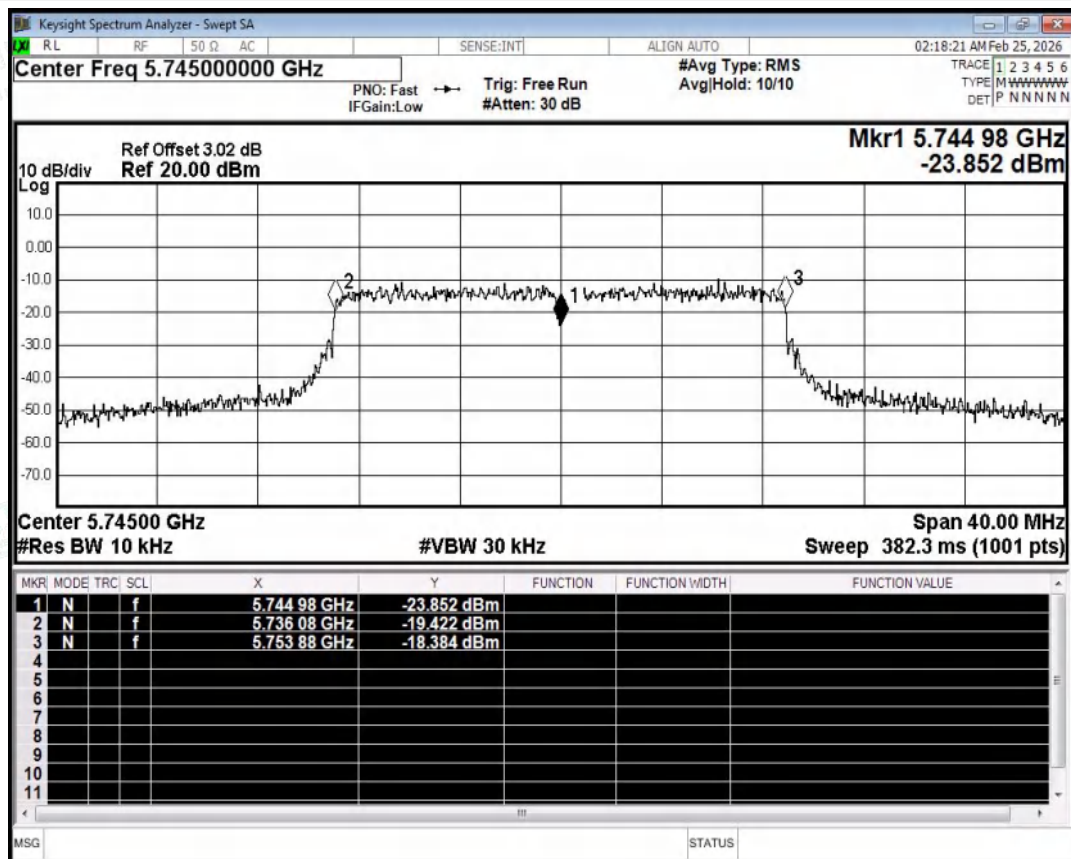

Freq. Stability NVNT ac20 5745MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

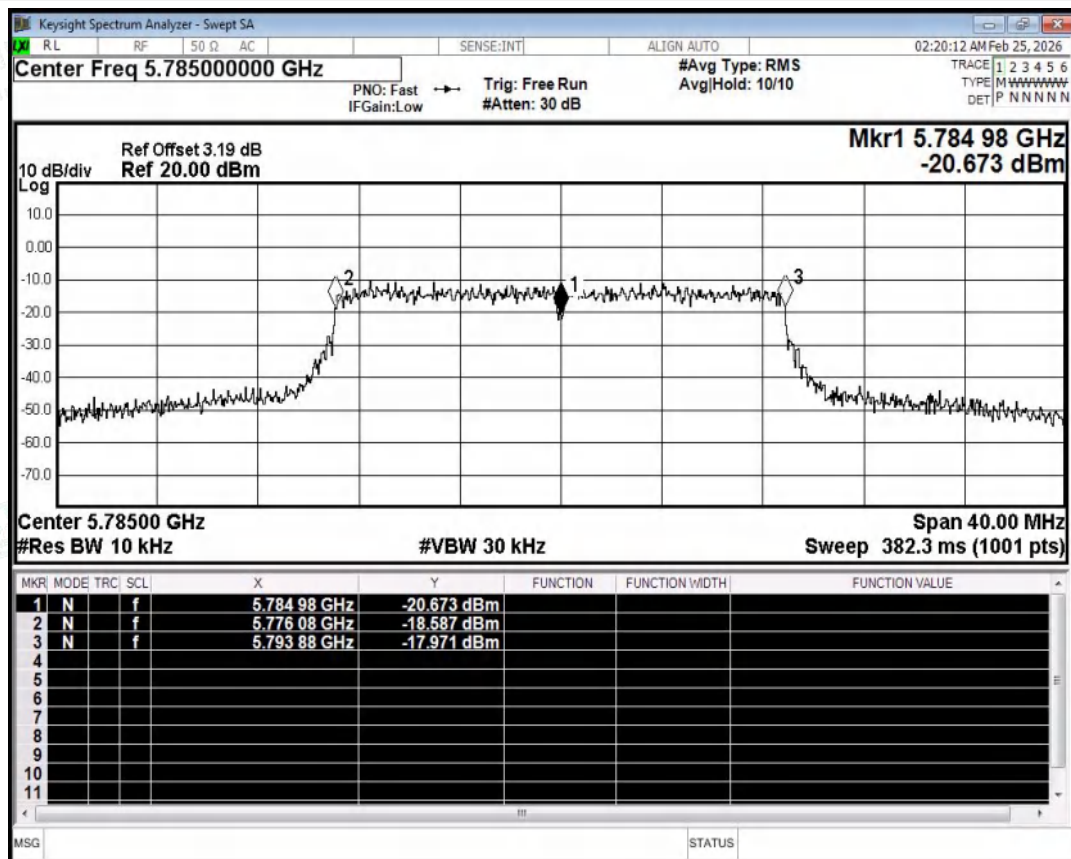

Freq. Stability NVNT ac20 5785MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

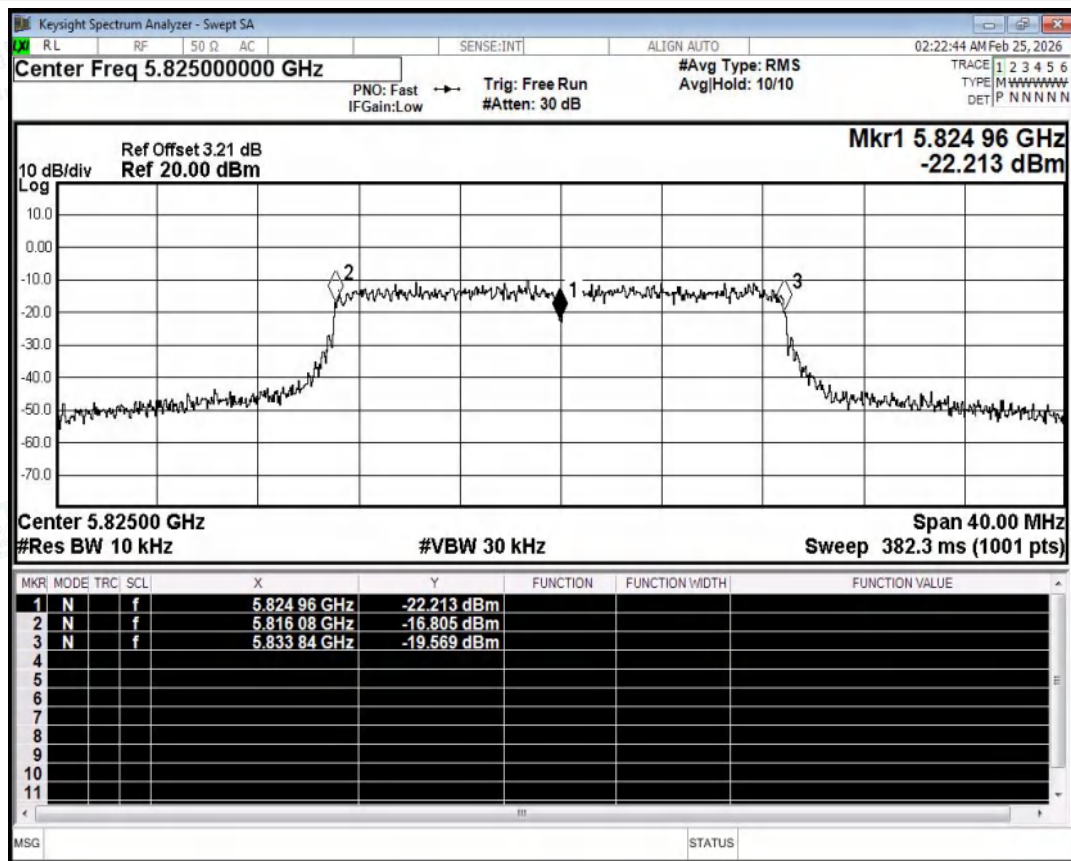

Freq. Stability NVNT ac20 5825MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

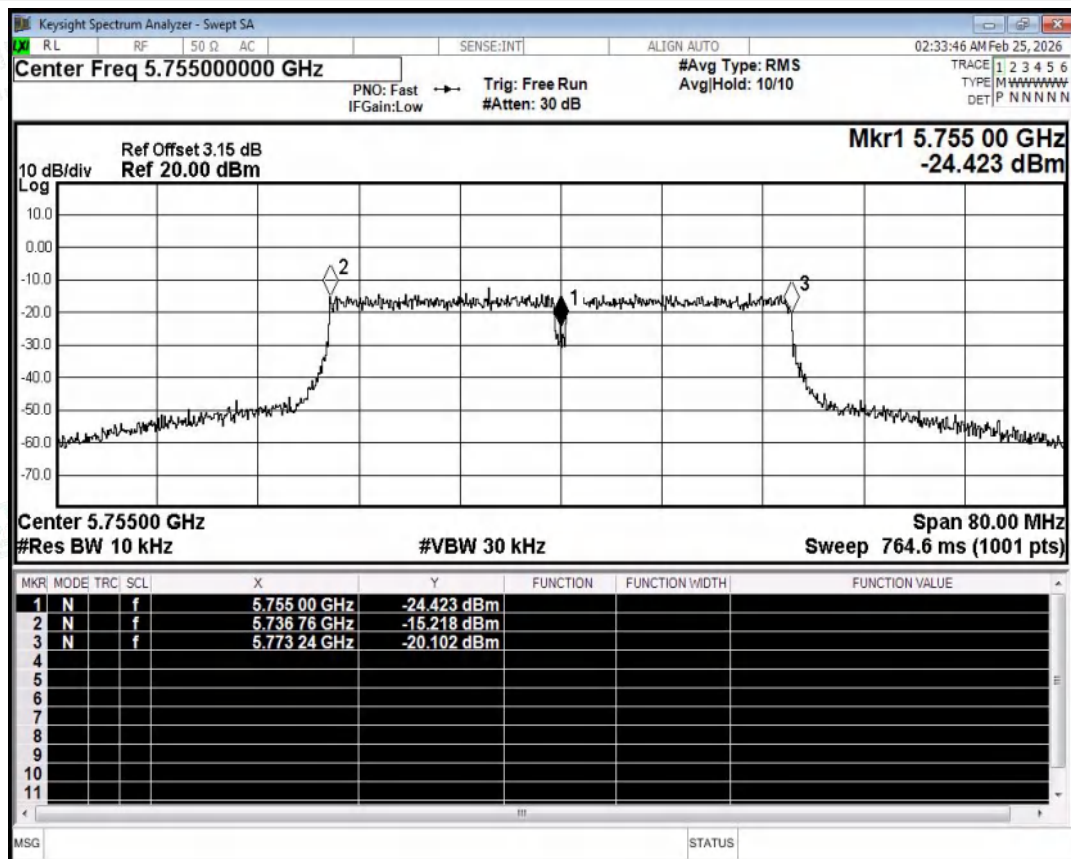

Freq. Stability NVNT ac40 5755MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

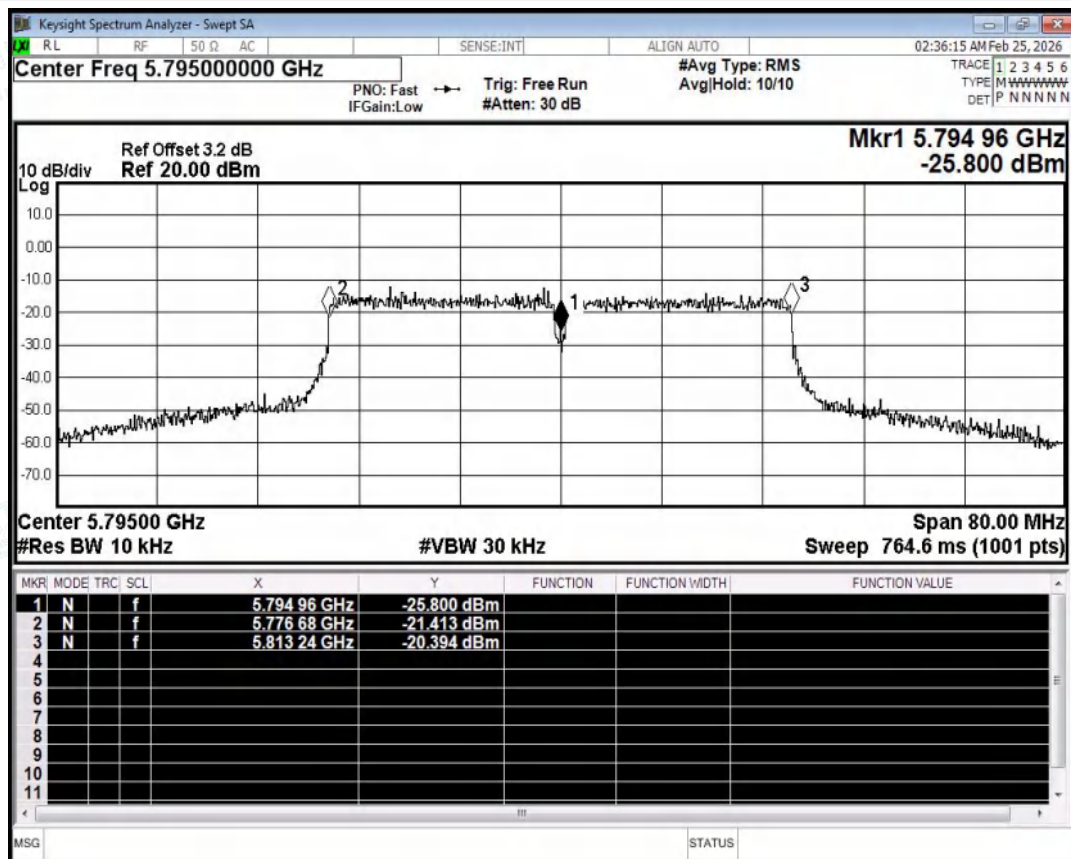

Freq. Stability NVNT ac40 5795MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

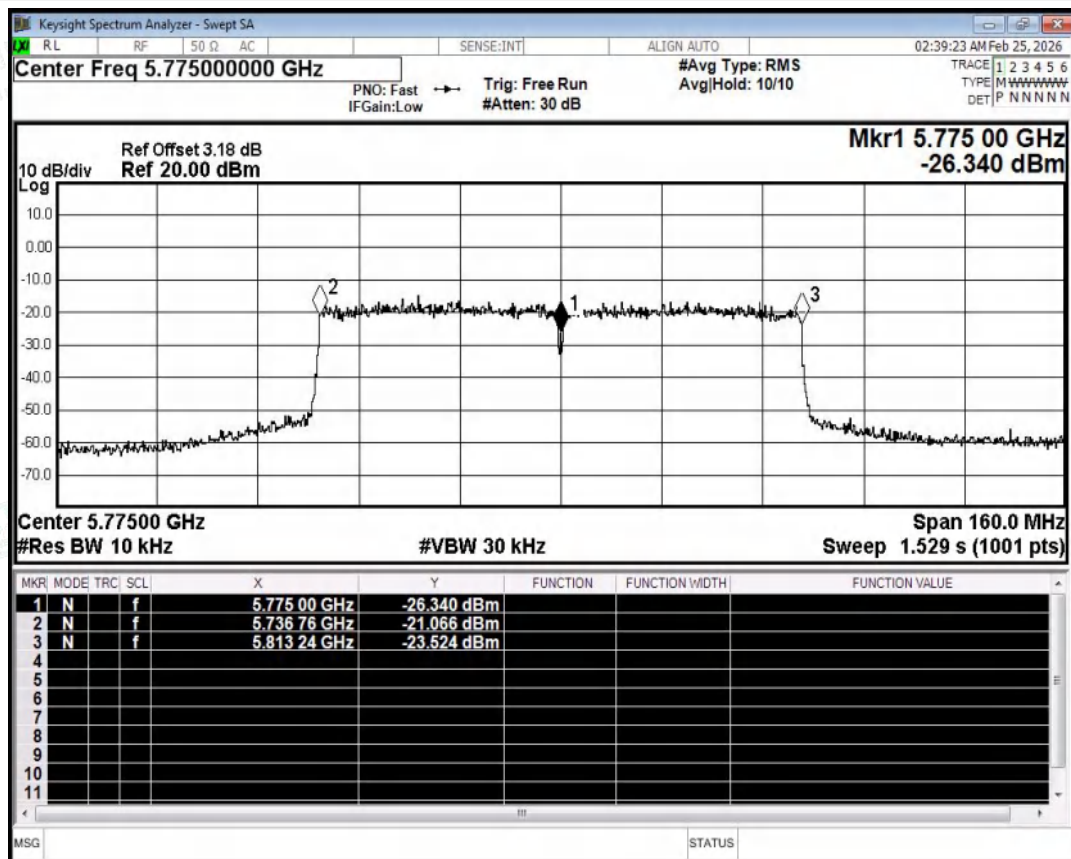

Freq. Stability NVNT ac80 5775MHz Ant1



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



## E.6 Duty Cycle

| Condition | Mode | Frequency (MHz) | Antenna | Duty Cycle (%) | Correction Factor (dB) | 1/T (kHz) |
|-----------|------|-----------------|---------|----------------|------------------------|-----------|
| NVNT      | a    | 5745            | Ant1    | 97.83          | 0.1                    | 0.37      |
| NVNT      | a    | 5785            | Ant1    | 97.83          | 0.1                    | 0.37      |
| NVNT      | a    | 5825            | Ant1    | 97.83          | 0.1                    | 0.37      |
| NVNT      | n20  | 5745            | Ant1    | 97             | 0.13                   | 0.44      |
| NVNT      | n20  | 5785            | Ant1    | 97.41          | 0.11                   | 0.44      |
| NVNT      | n20  | 5825            | Ant1    | 97             | 0.13                   | 0.44      |
| NVNT      | n40  | 5755            | Ant1    | 94.87          | 0.23                   | 0.9       |
| NVNT      | n40  | 5795            | Ant1    | 94.87          | 0.23                   | 0.9       |
| NVNT      | ac20 | 5745            | Ant1    | 97.42          | 0.11                   | 0.44      |
| NVNT      | ac20 | 5785            | Ant1    | 97.42          | 0.11                   | 0.44      |
| NVNT      | ac20 | 5825            | Ant1    | 97.42          | 0.11                   | 0.44      |
| NVNT      | ac40 | 5755            | Ant1    | 94.07          | 0.27                   | 0.9       |
| NVNT      | ac40 | 5795            | Ant1    | 94.87          | 0.23                   | 0.9       |
| NVNT      | ac80 | 5775            | Ant1    | 90             | 0.46                   | 1.85      |




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

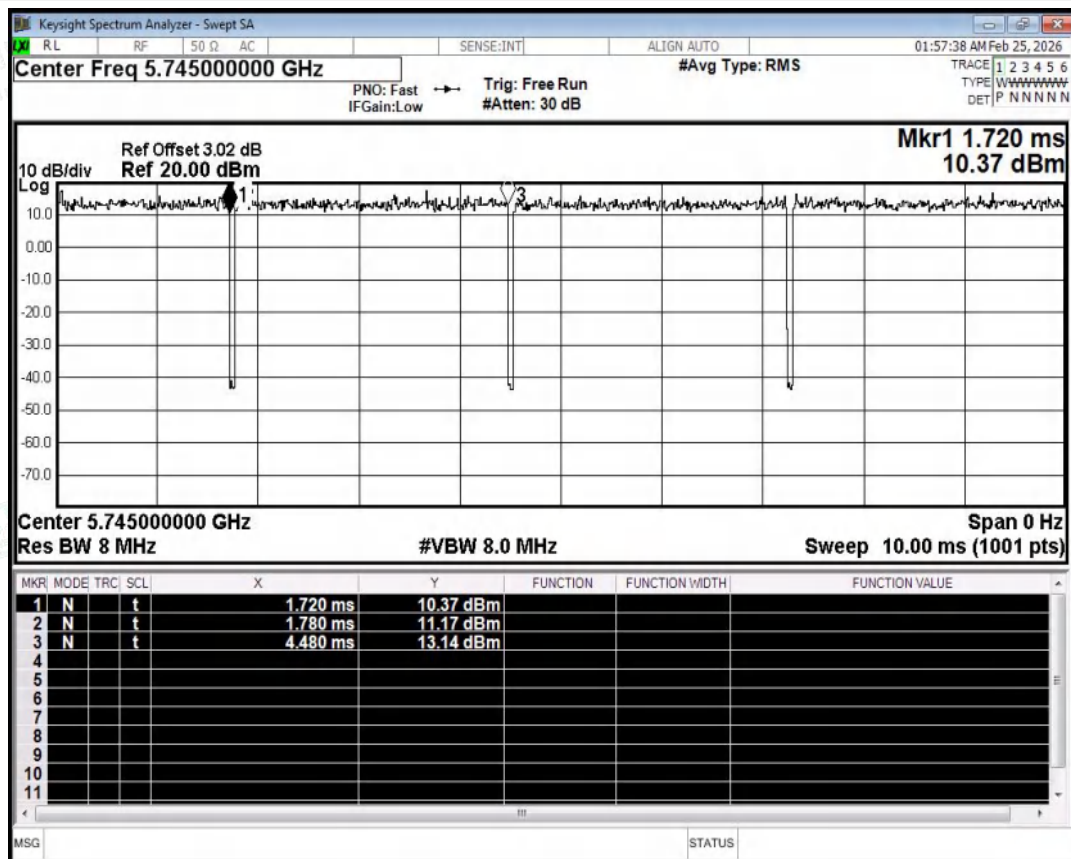

Duty Cycle NVNT a 5745MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

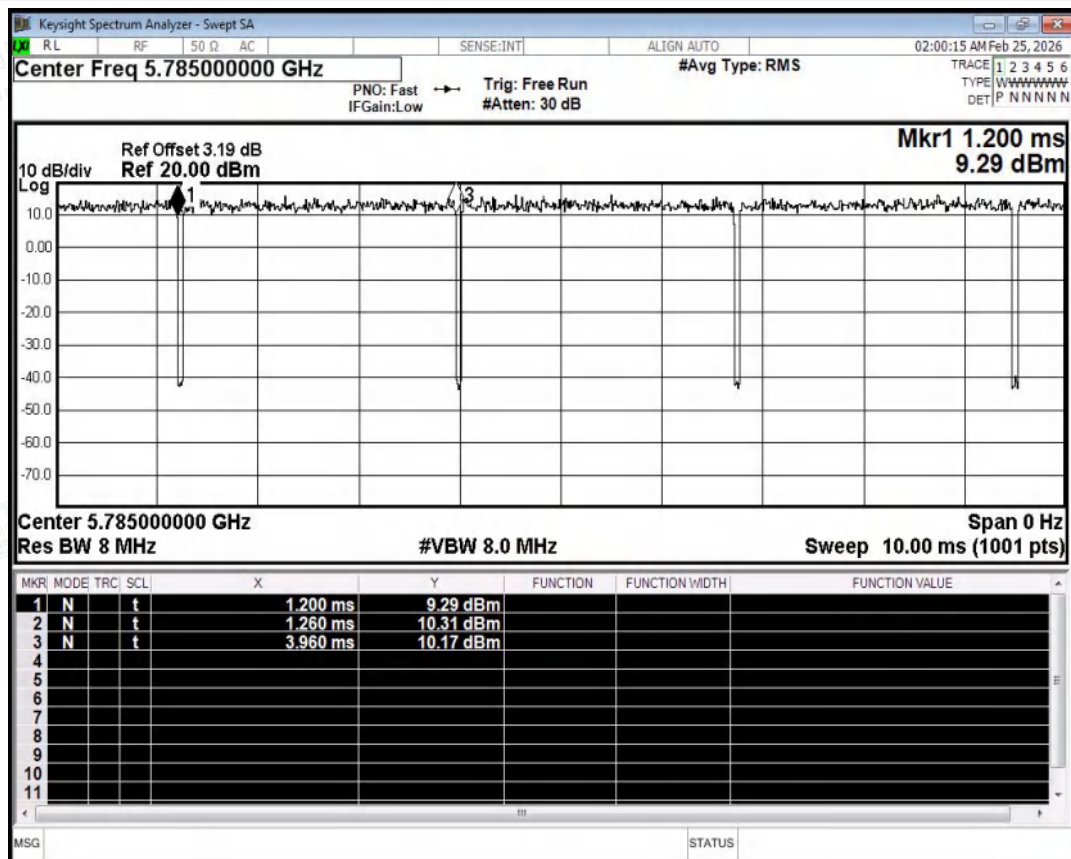

Duty Cycle NVNT a 5785MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

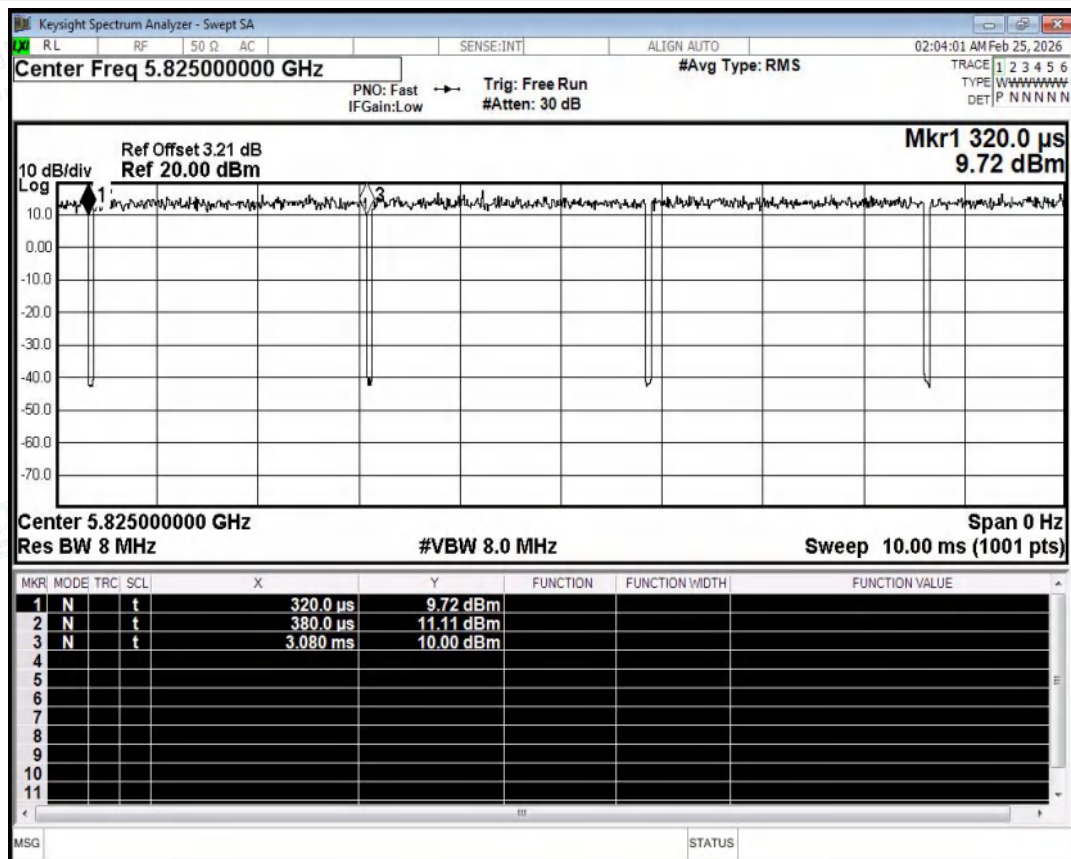

Duty Cycle NVNT a 5825MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

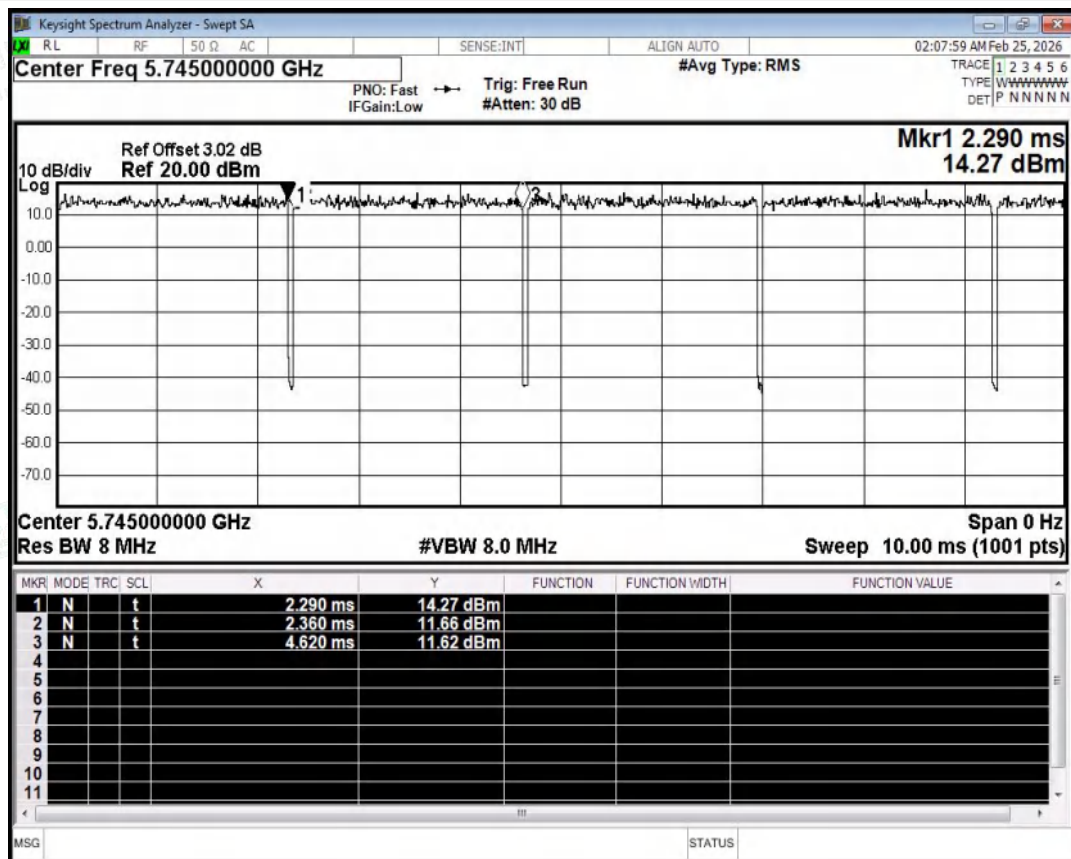

Duty Cycle NVNT n20 5745MHz Ant1



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Duty Cycle NVNT n20 5785MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

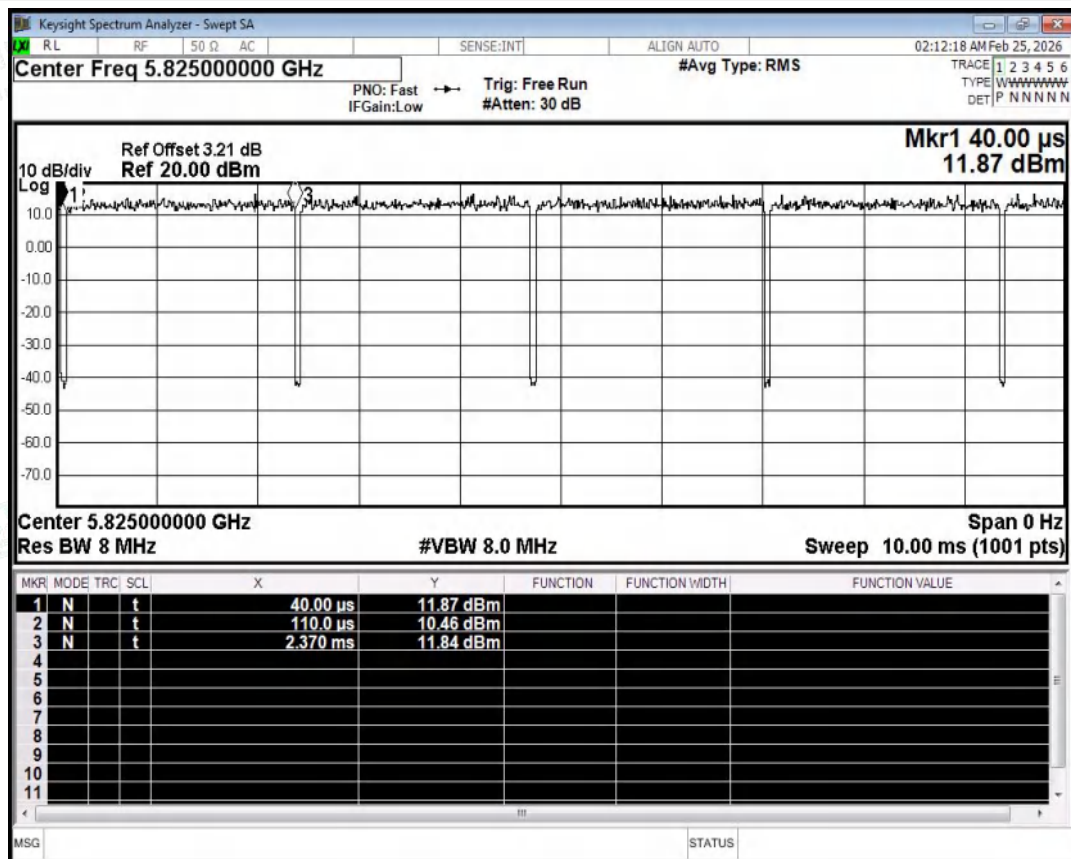

Duty Cycle NVNT n20 5825MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

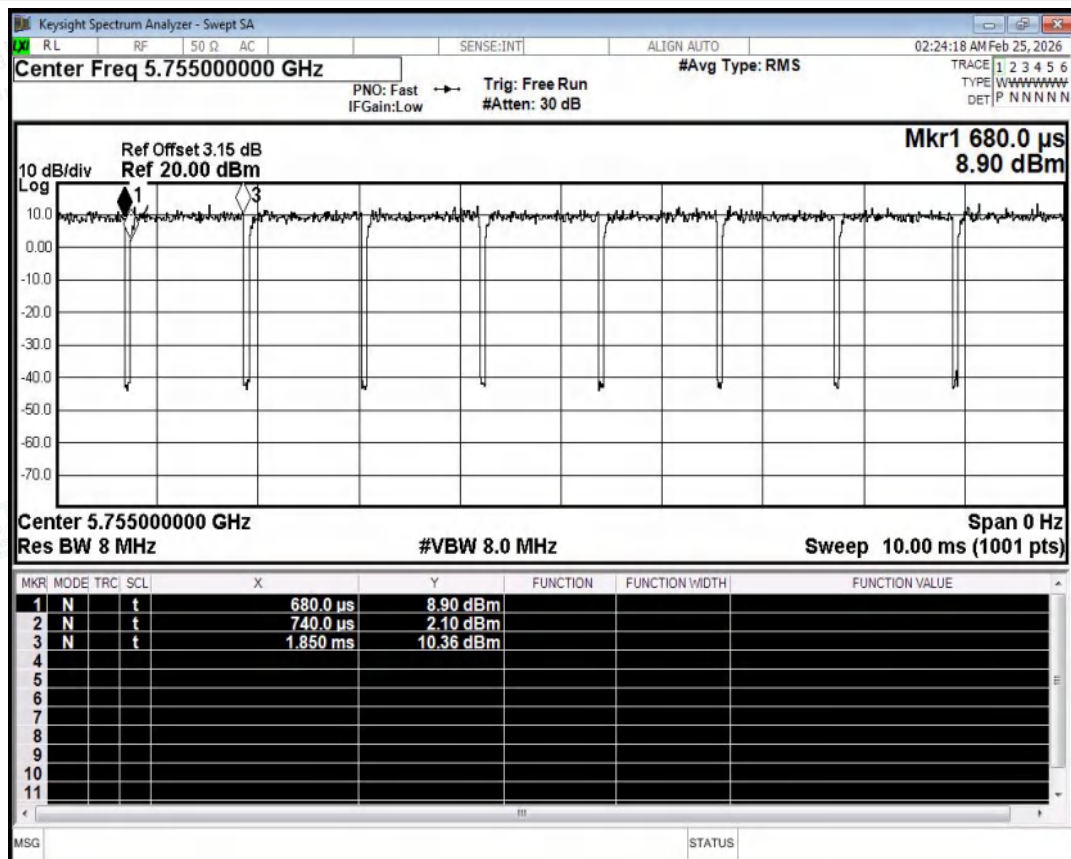

Duty Cycle NVNT n40 5755MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

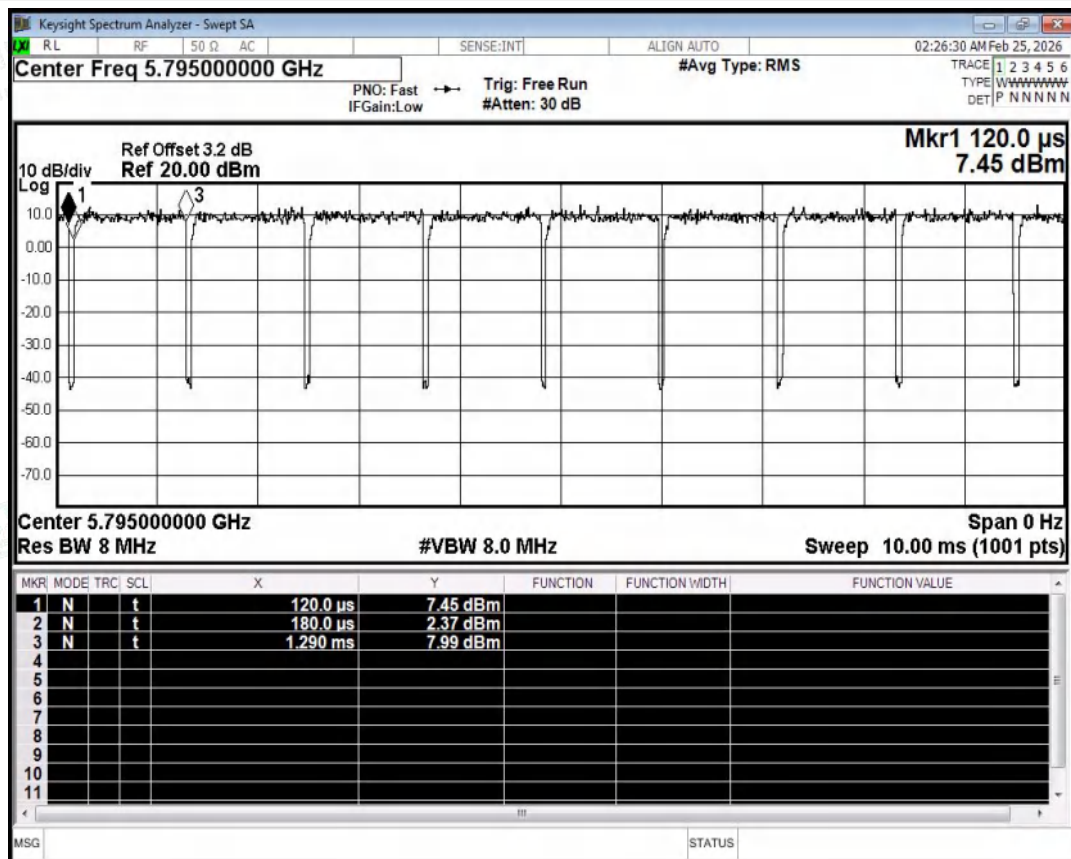

Duty Cycle NVNT n40 5795MHz Ant1



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Duty Cycle NVNT ac20 5745MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

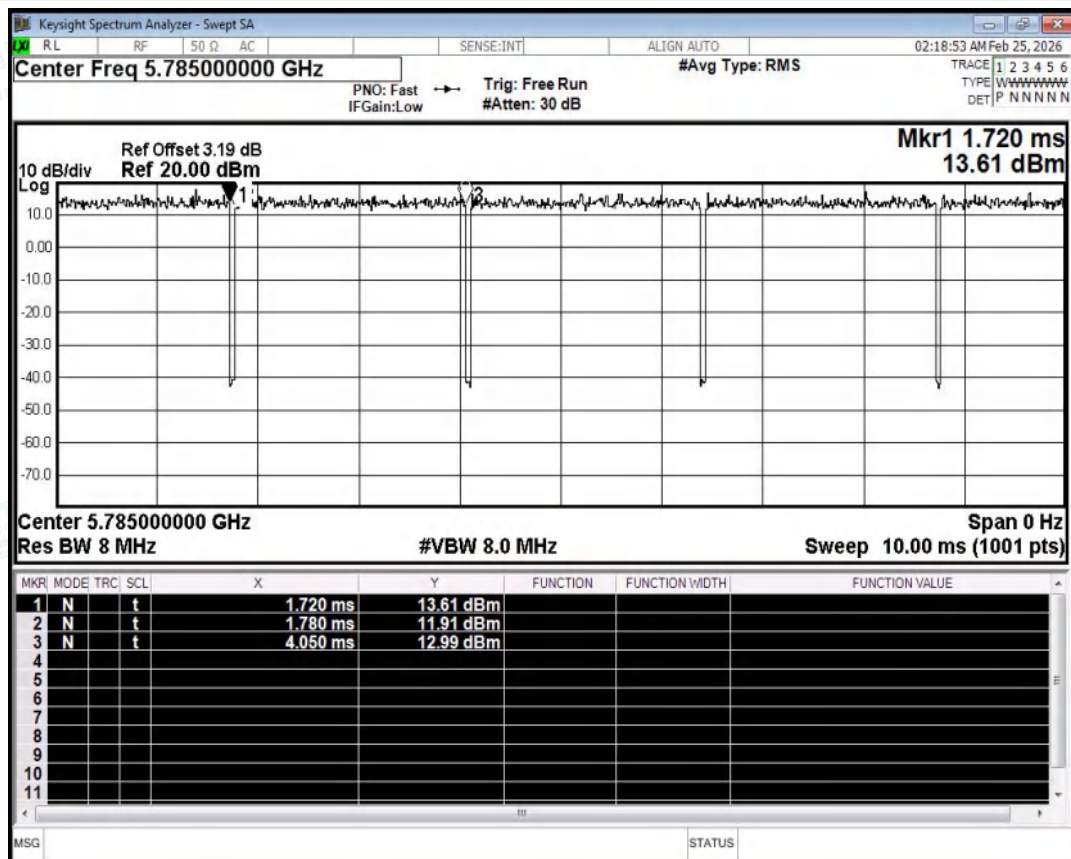

Duty Cycle NVNT ac20 5785MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

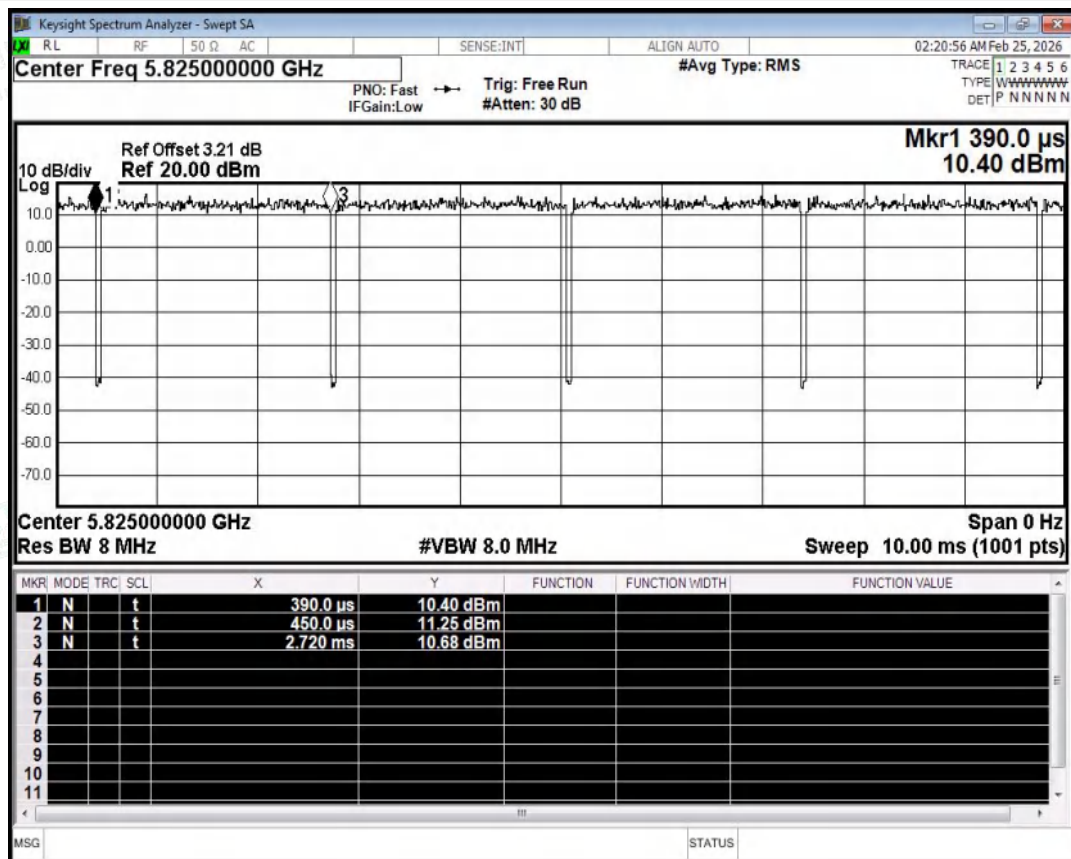

Duty Cycle NVNT ac20 5825MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

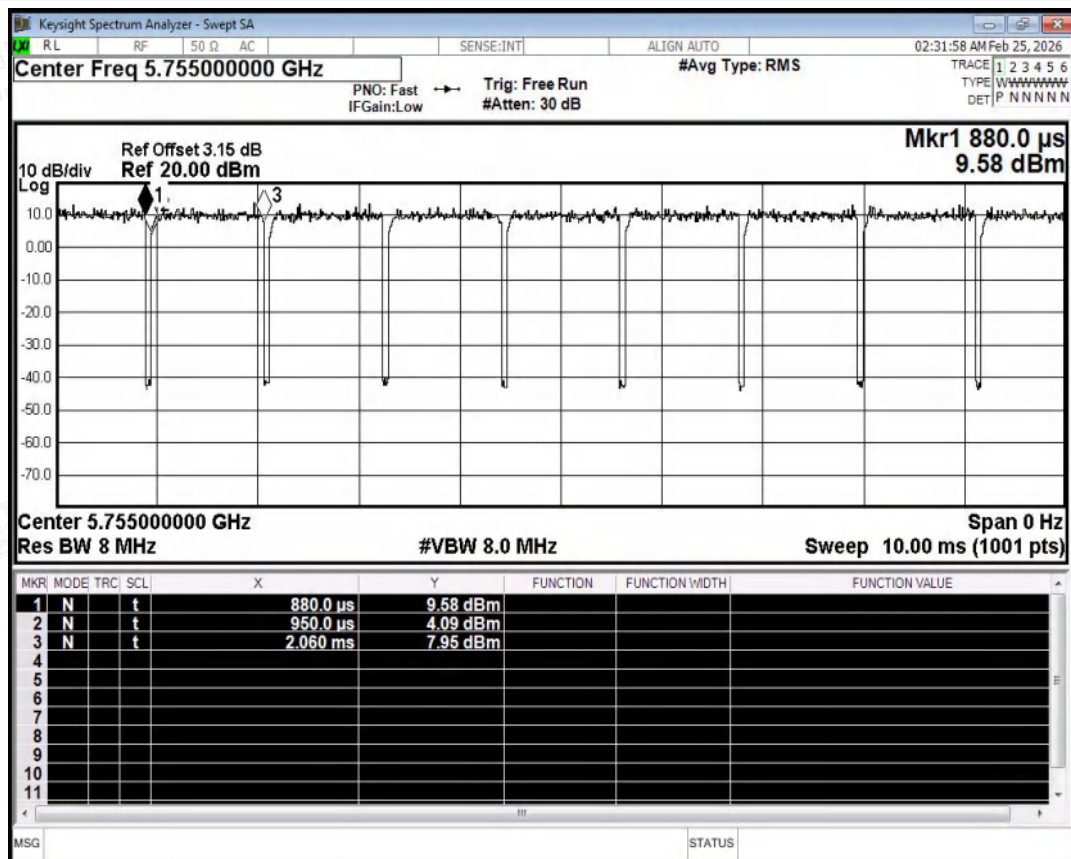

Duty Cycle NVNT ac40 5755MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

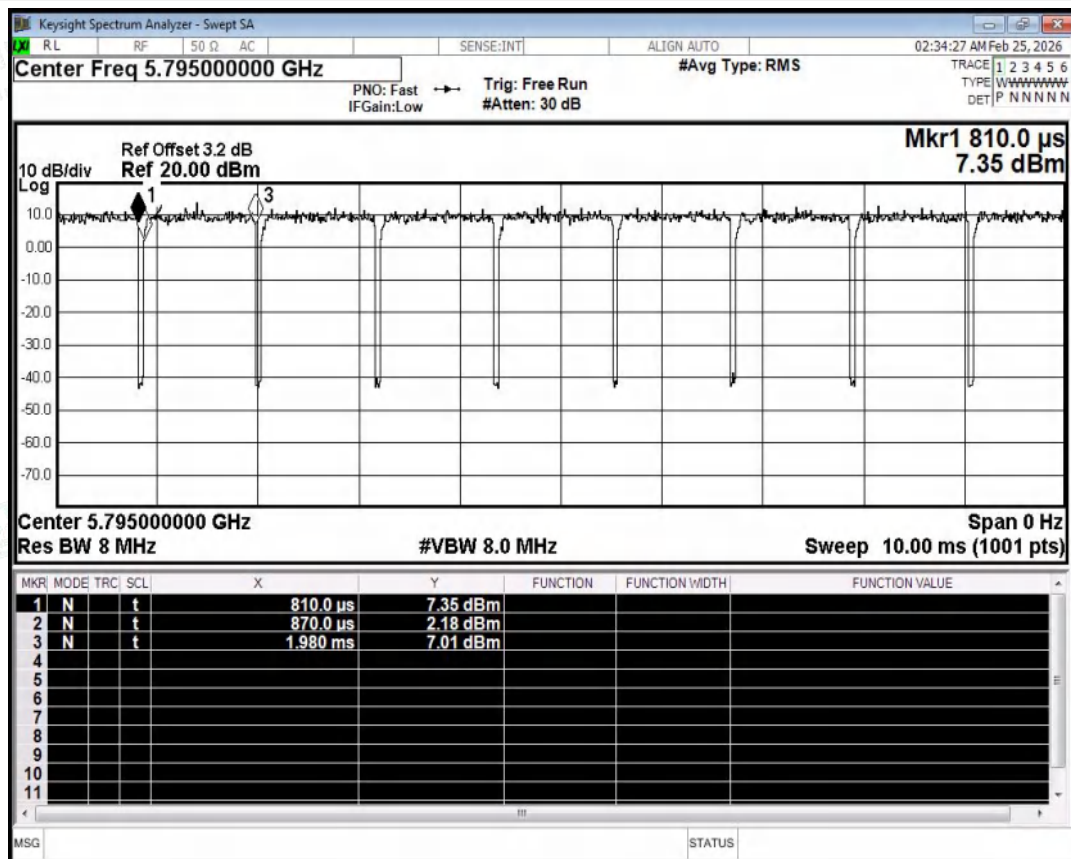

Duty Cycle NVNT ac40 5795MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

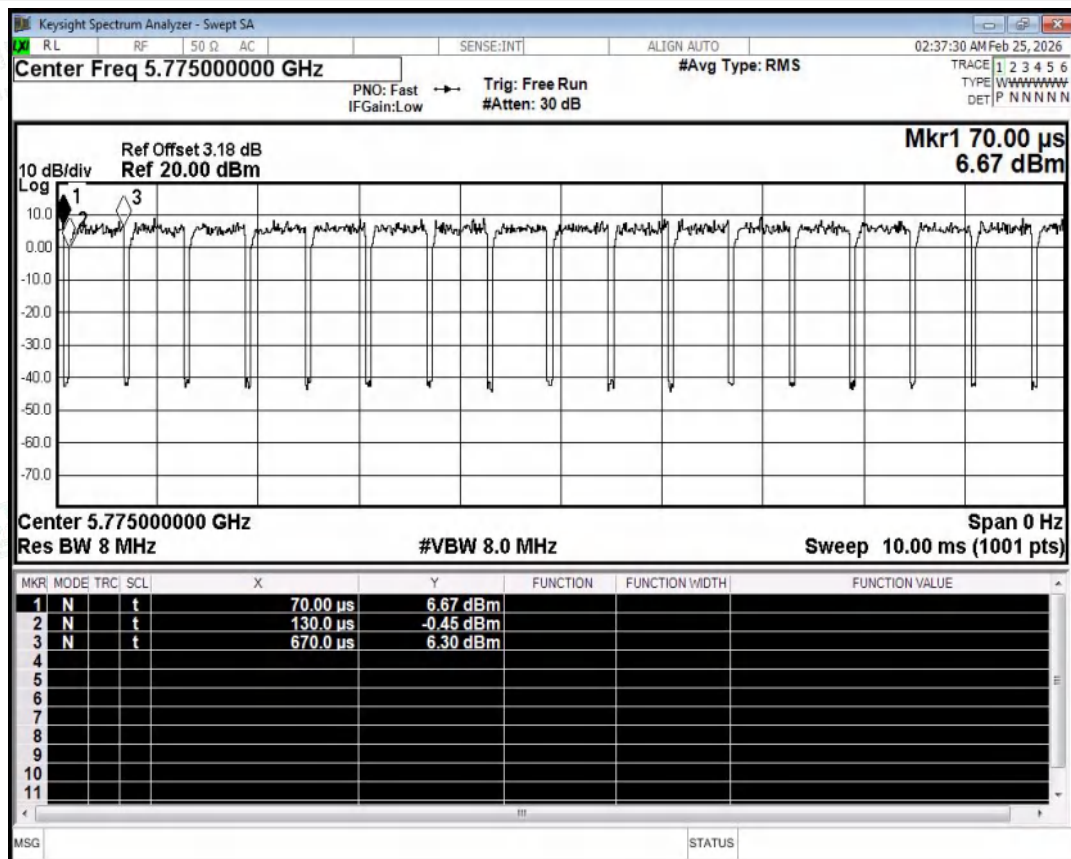

Duty Cycle NVNT ac80 5775MHz Ant1



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: [webmaster@lcs-cert.com](mailto:webmaster@lcs-cert.com) | Web: [www.lcs-cert.com](http://www.lcs-cert.com)

Scan code to check authenticity