

Appendix Test Data

Report No.:	1812C50456912501-01	Test Sample No.:	1-2-2
Start Test Date:	2025-09-29	Finish Test Date:	2025-10-01
Test Engineer:	<i>Alex Peng</i>	Auditor:	<i>Justin Feng</i>
Temperature:	26.2°C	Relative Humidity:	51%
Pressure:	101kPa		



Appendix A: 6dB Bandwidth

Test Result

Test Mode	Antenna	Frequency[MHz]	6dB BW [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11B	Ant1	2412	11.600	2406.040	2417.640	0.5	PASS
11B	Ant1	2437	11.280	2431.320	2442.600	0.5	PASS
11B	Ant1	2462	11.480	2456.320	2467.800	0.5	PASS
11G	Ant1	2412	15.720	2404.040	2419.760	0.5	PASS
11G	Ant1	2437	15.200	2429.560	2444.760	0.5	PASS
11G	Ant1	2462	15.840	2454.080	2469.920	0.5	PASS
11N20SISO	Ant1	2412	17.480	2403.320	2420.800	0.5	PASS
11N20SISO	Ant1	2437	17.480	2428.280	2445.760	0.5	PASS
11N20SISO	Ant1	2462	17.440	2453.320	2470.760	0.5	PASS
11AX20SISO	Ant1	2412	18.560	2402.800	2421.360	0.5	PASS
11AX20SISO	Ant1	2437	18.600	2427.800	2446.400	0.5	PASS
11AX20SISO	Ant1	2462	18.600	2452.800	2471.400	0.5	PASS


Test Graphs




Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

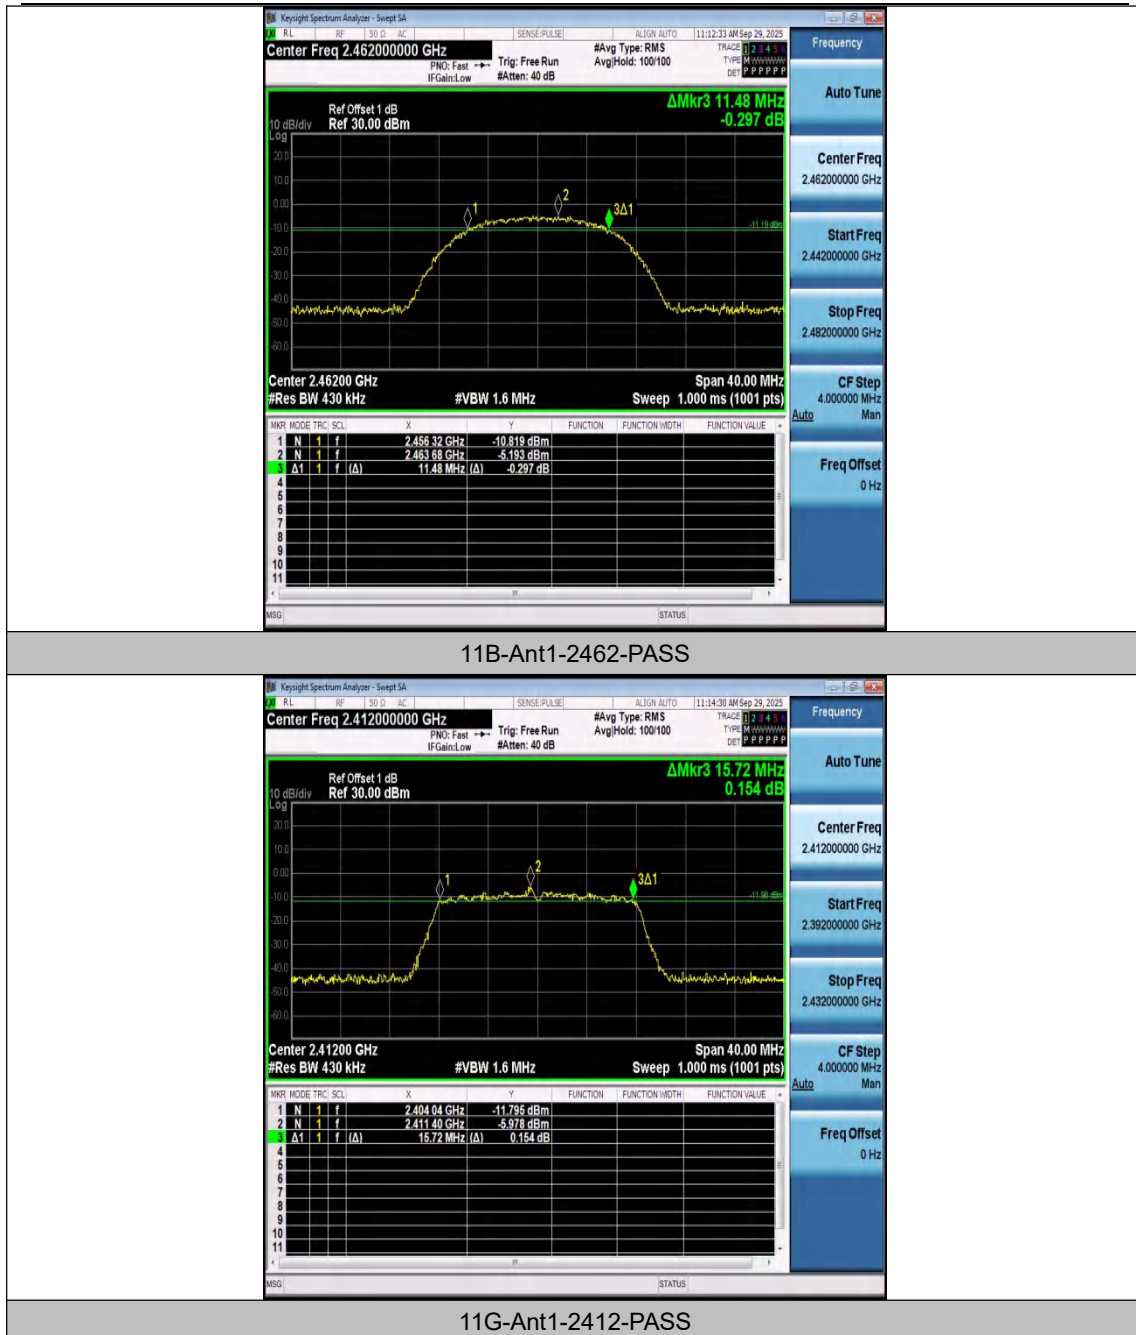


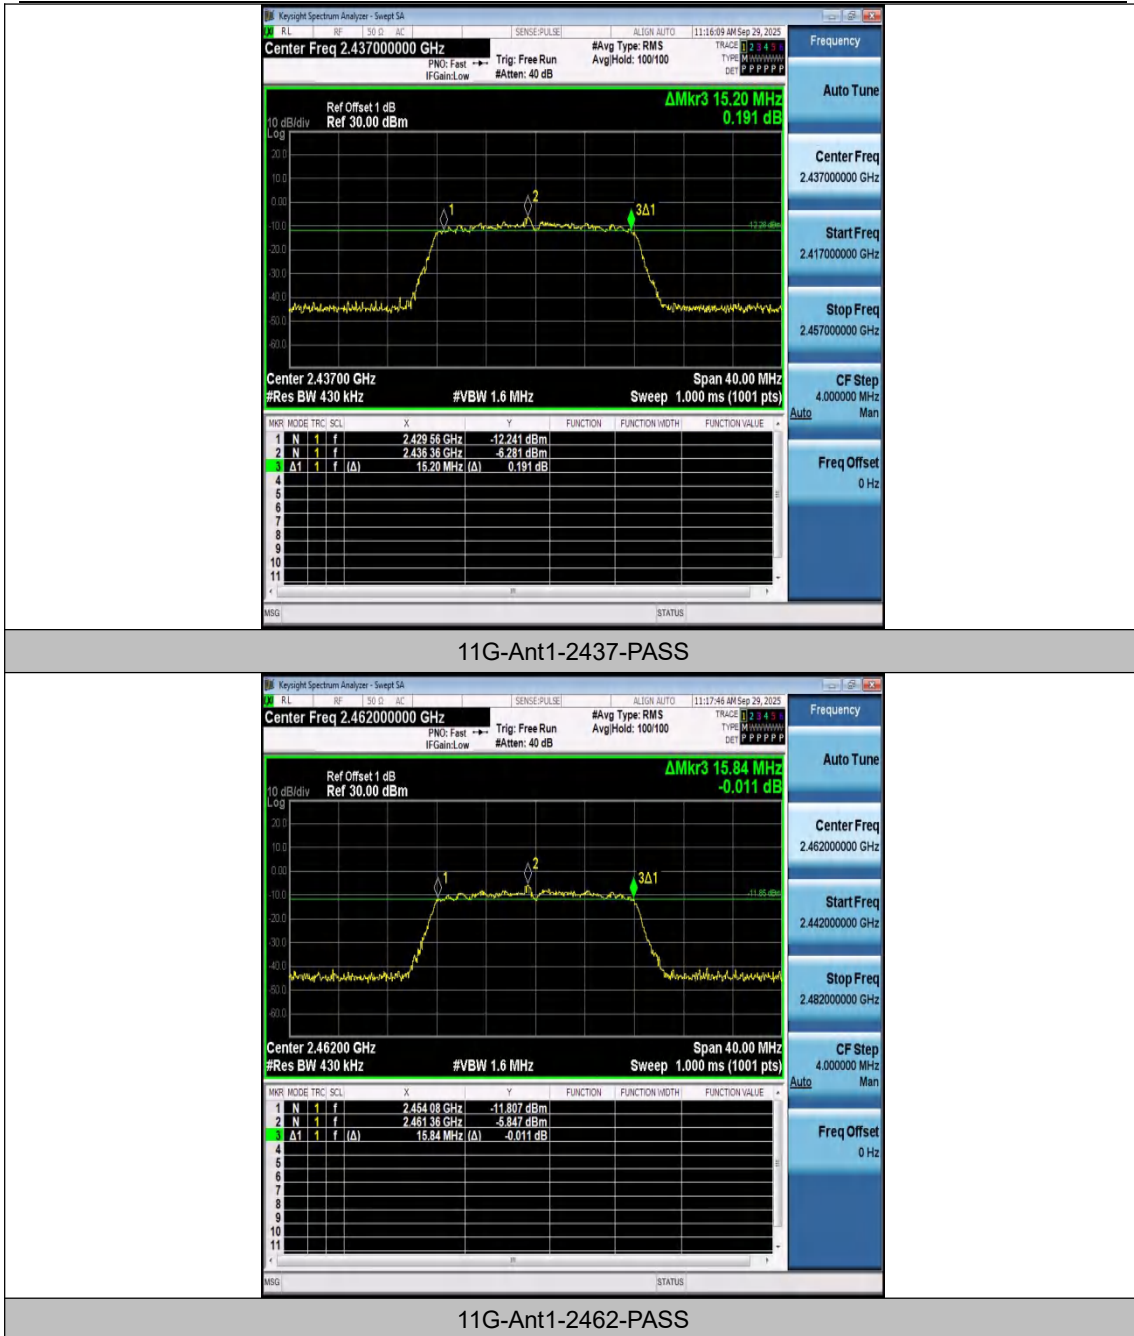

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

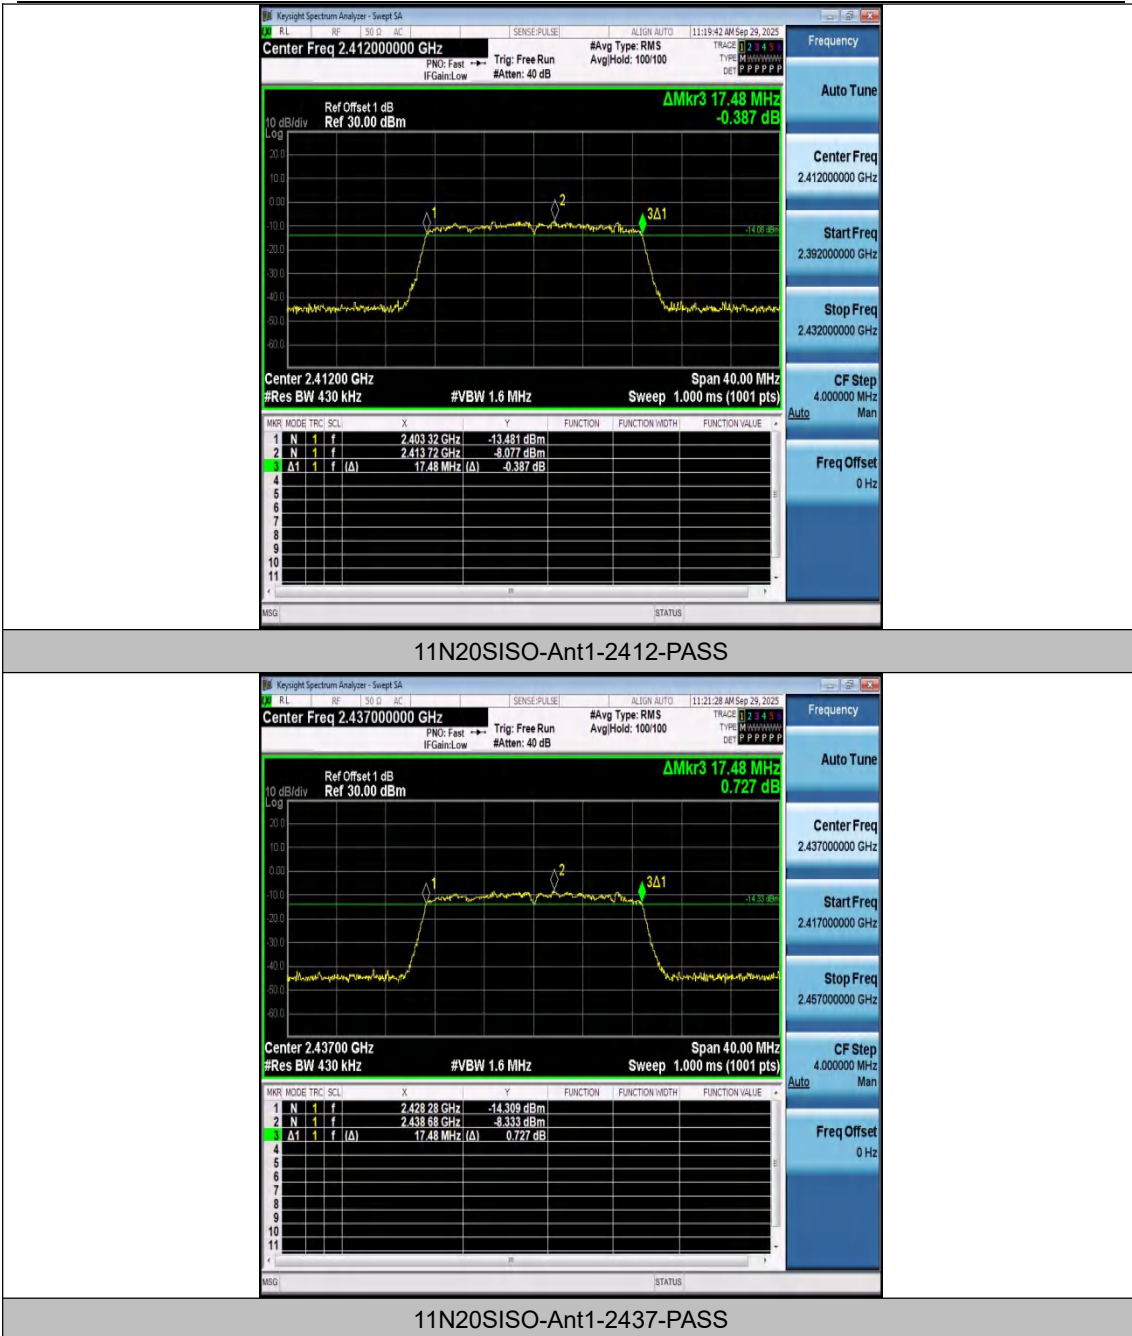


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

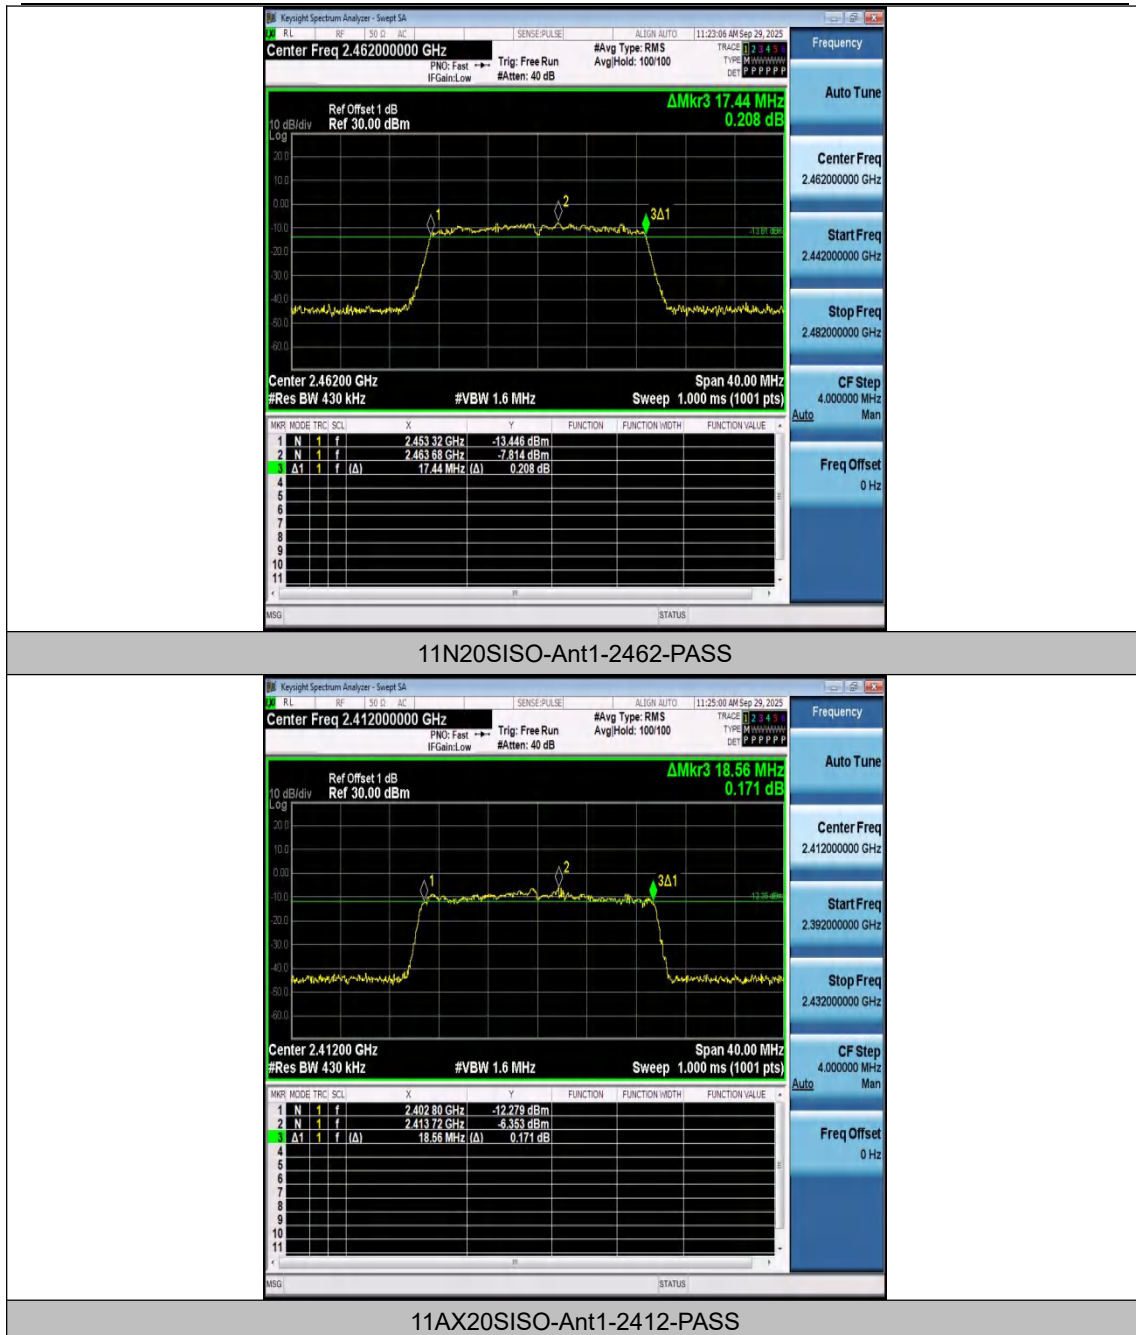

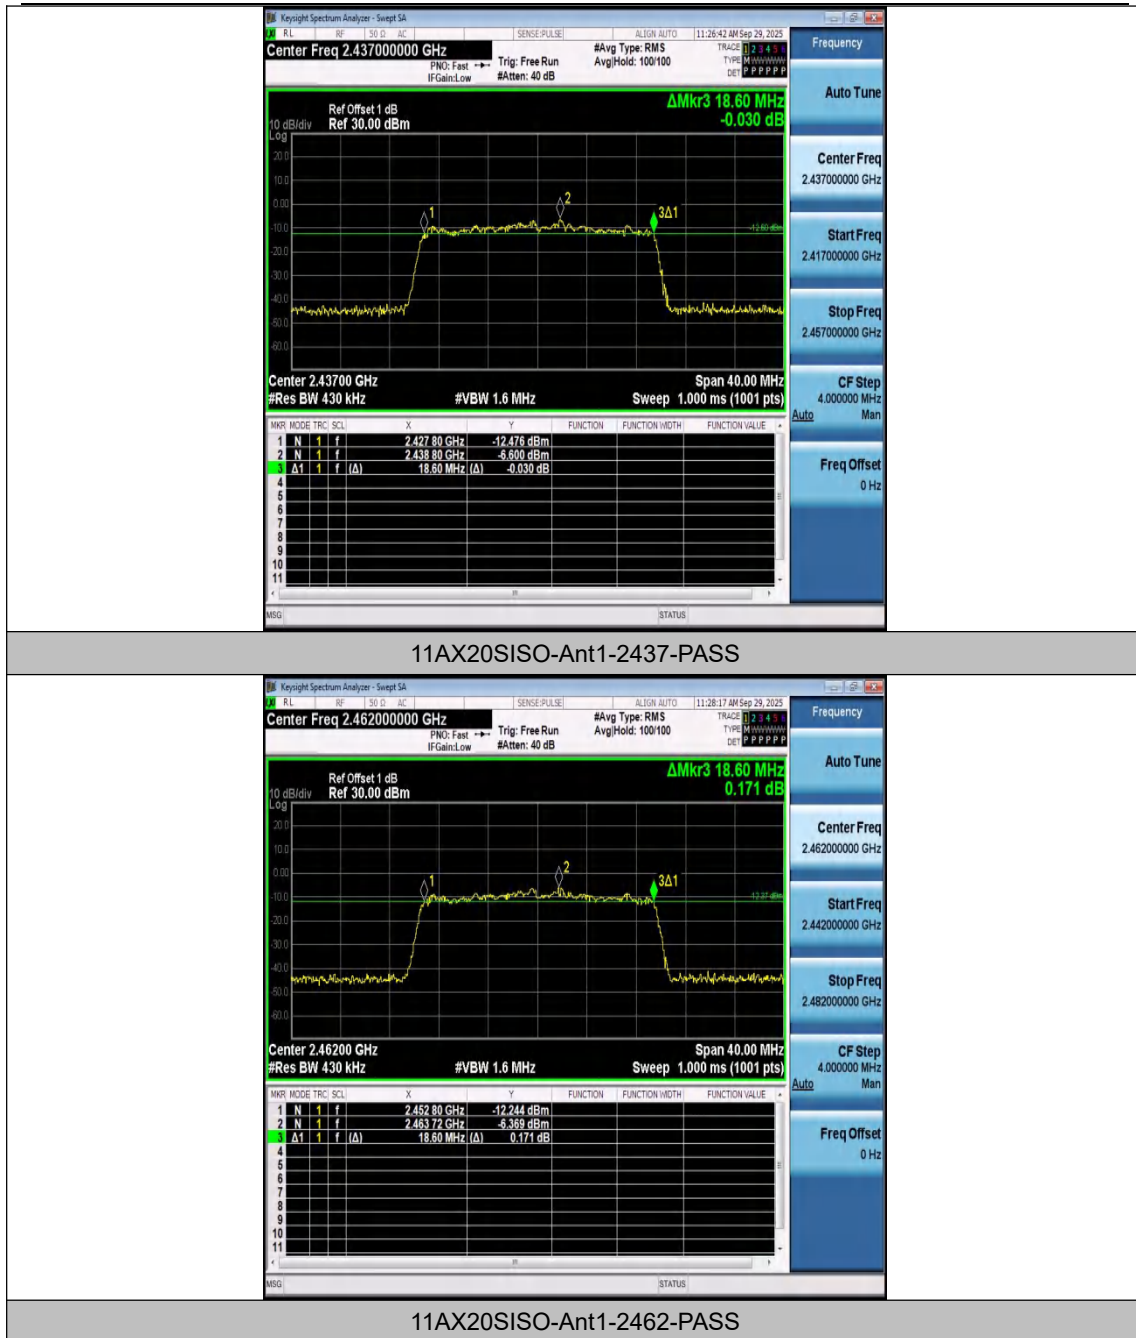

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix B: 99% Occupied Bandwidth

Test Result

Test Mode	Antenna	Channel Frequency[MHz]	OCB [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11B	Ant1	2412	14.925	2404.5362	2419.4612	---	---
11B	Ant1	2437	14.889	2429.5806	2444.4696	---	---
11B	Ant1	2462	14.881	2454.5998	2469.4808	---	---
11G	Ant1	2412	16.519	2403.7522	2420.2712	---	---
11G	Ant1	2437	16.499	2428.7606	2445.2596	---	---
11G	Ant1	2462	16.495	2453.7651	2470.2601	---	---
11N20SISO	Ant1	2412	17.546	2403.2743	2420.8203	---	---
11N20SISO	Ant1	2437	17.555	2428.2773	2445.8323	---	---
11N20SISO	Ant1	2462	17.539	2453.2890	2470.8280	---	---
11AX20SISO	Ant1	2412	18.861	2402.6183	2421.4793	---	---
11AX20SISO	Ant1	2437	18.832	2427.6430	2446.4750	---	---
11AX20SISO	Ant1	2462	18.845	2452.6253	2471.4703	---	---


Test Graphs

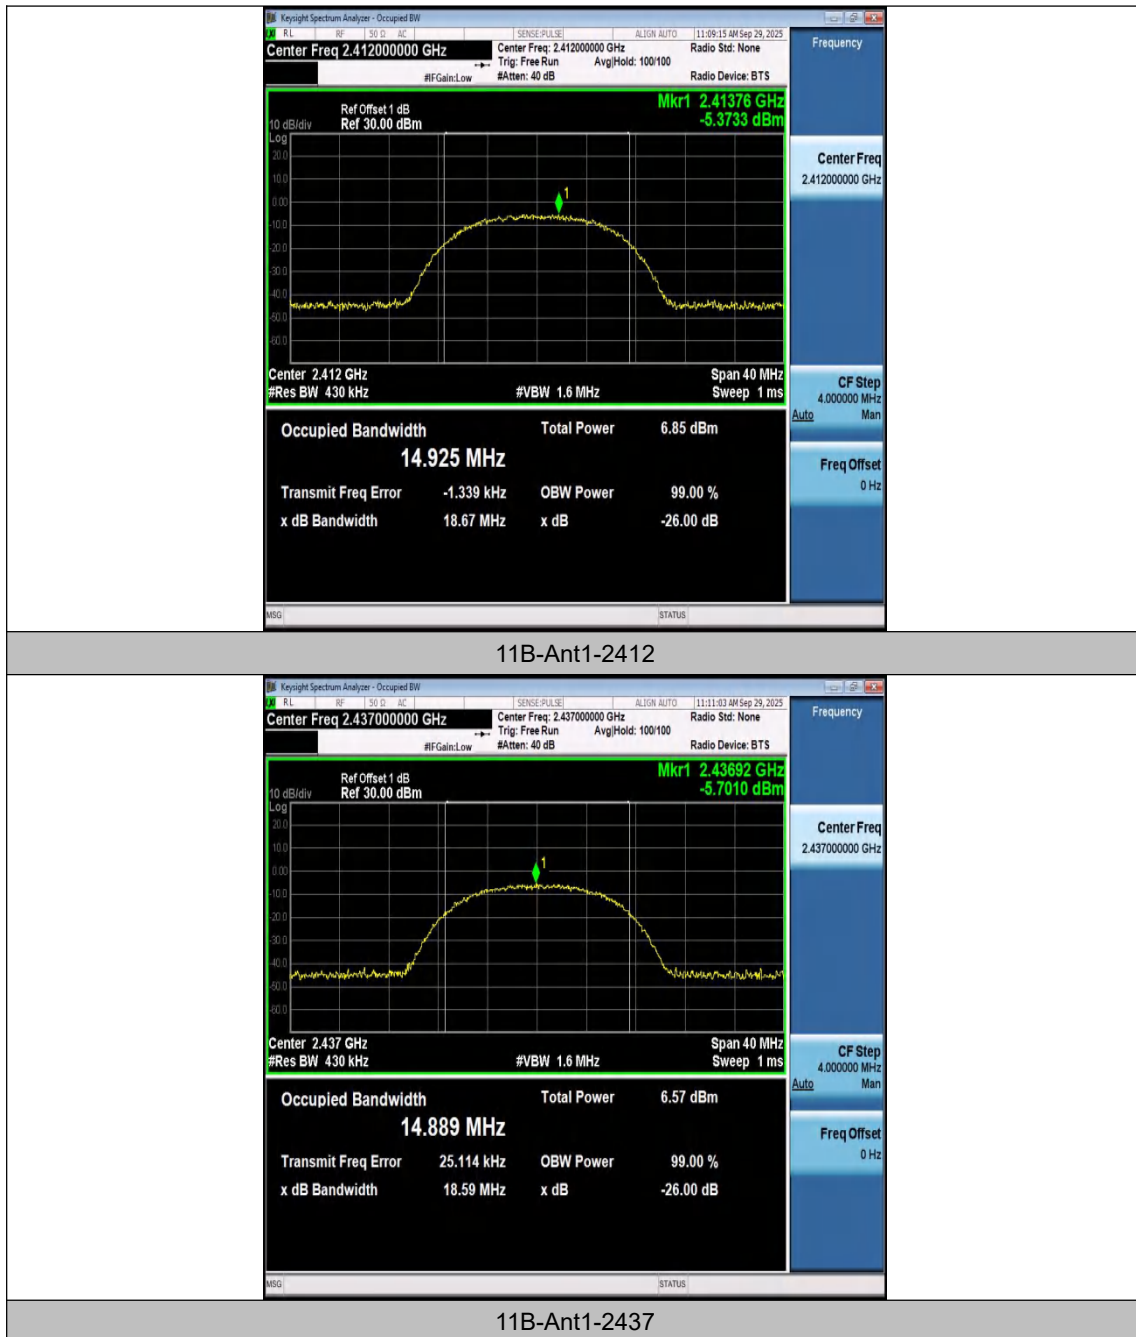

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

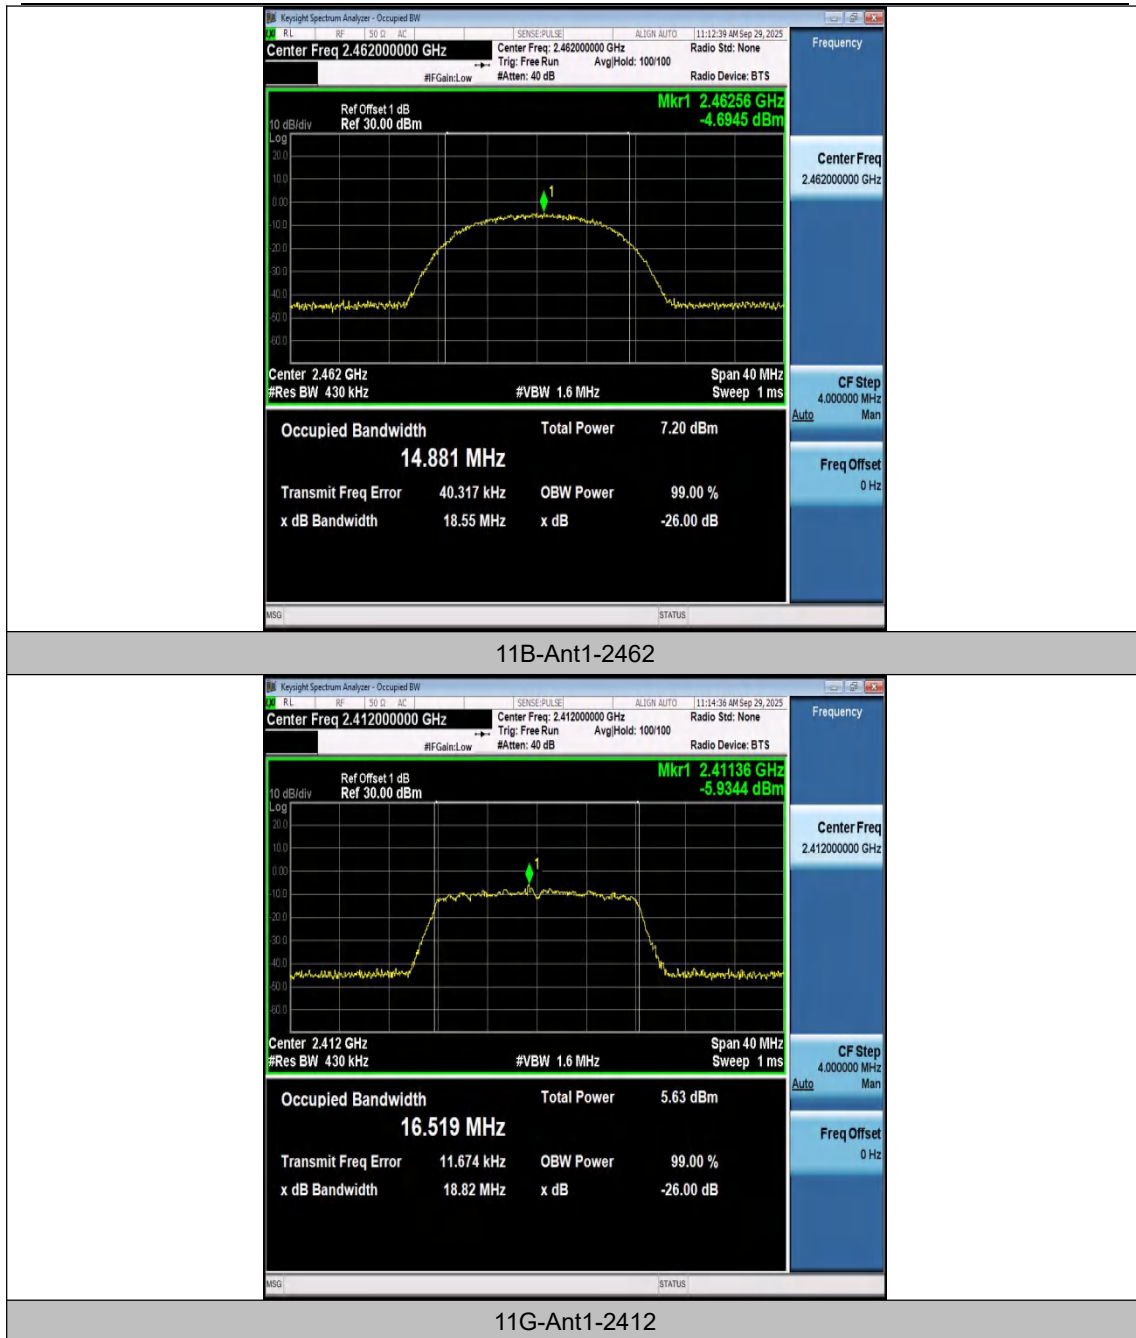

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

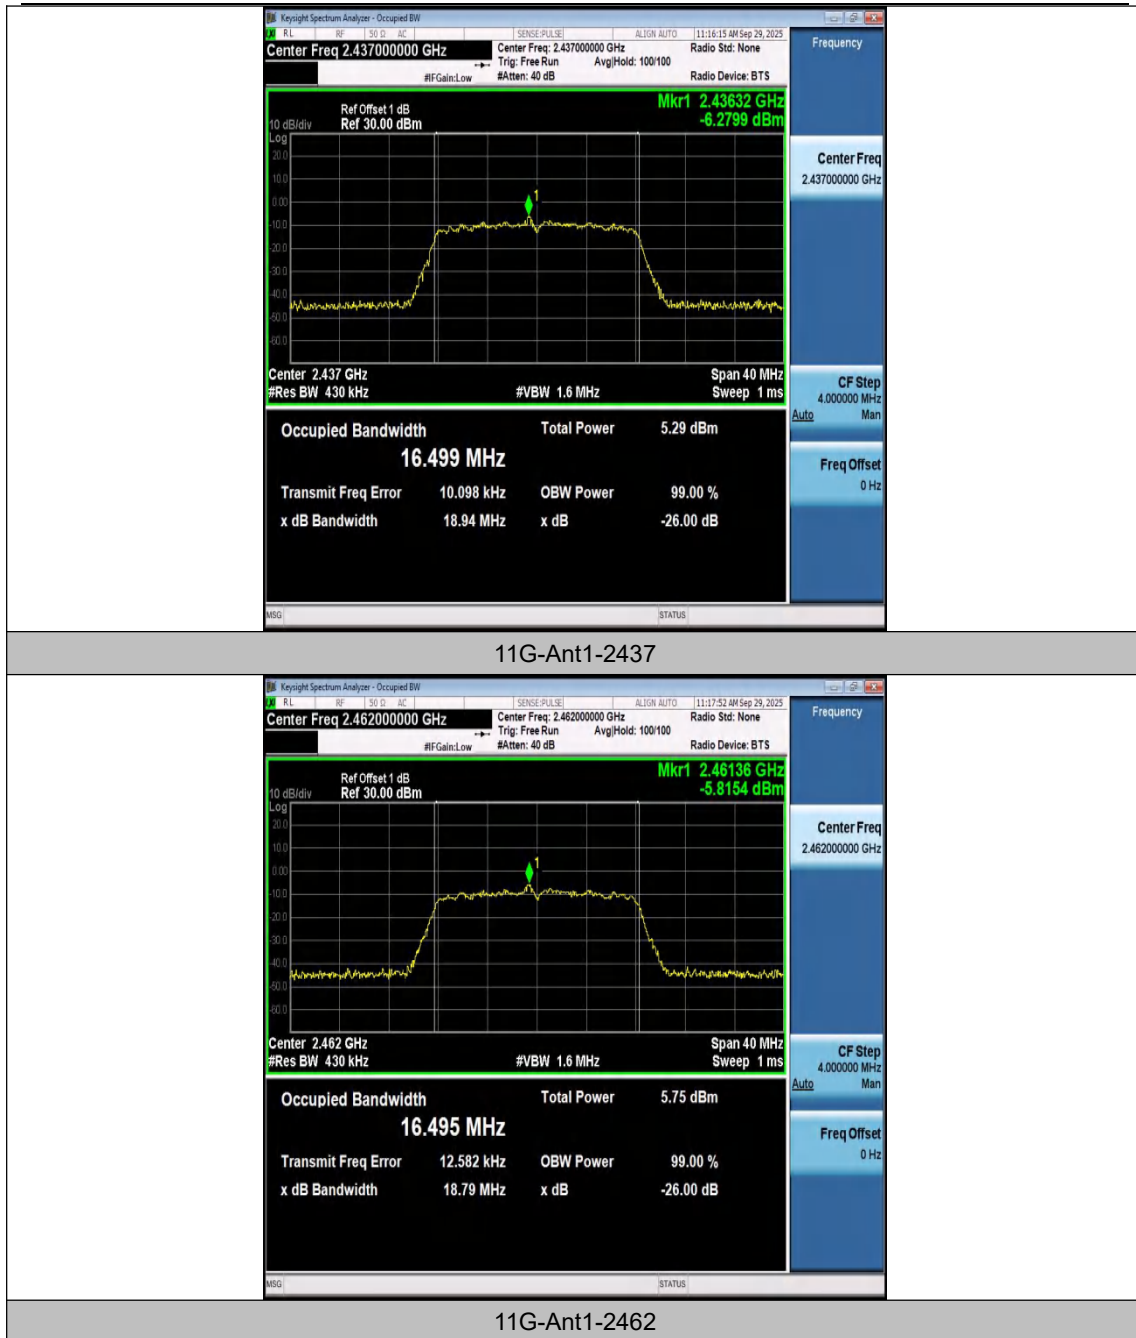

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

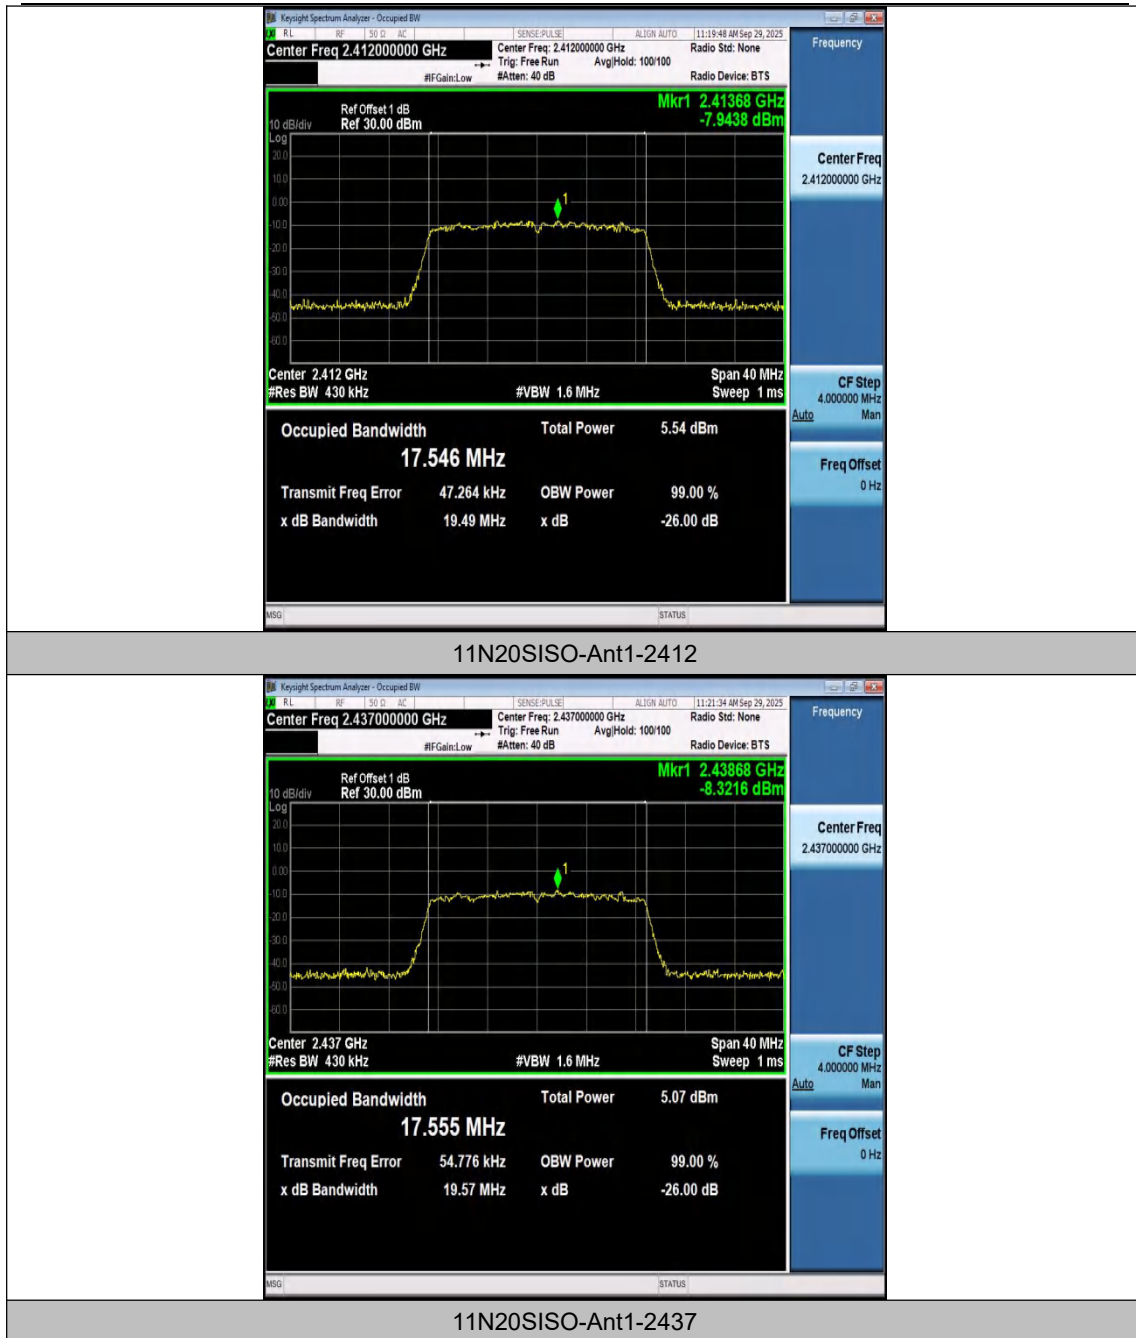

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

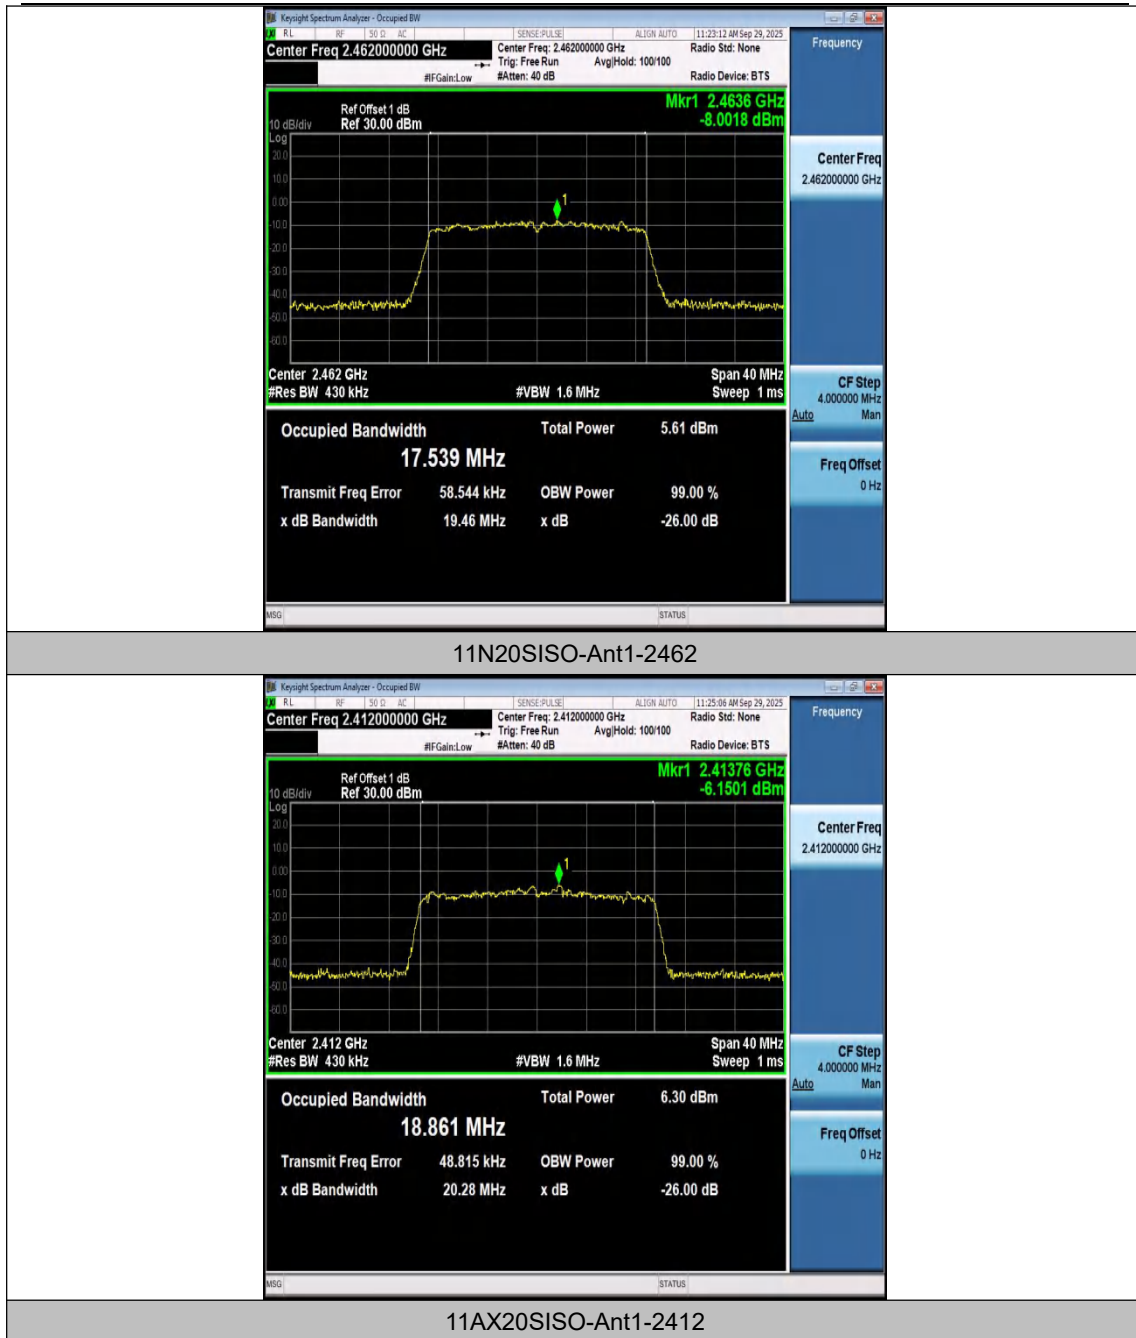

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

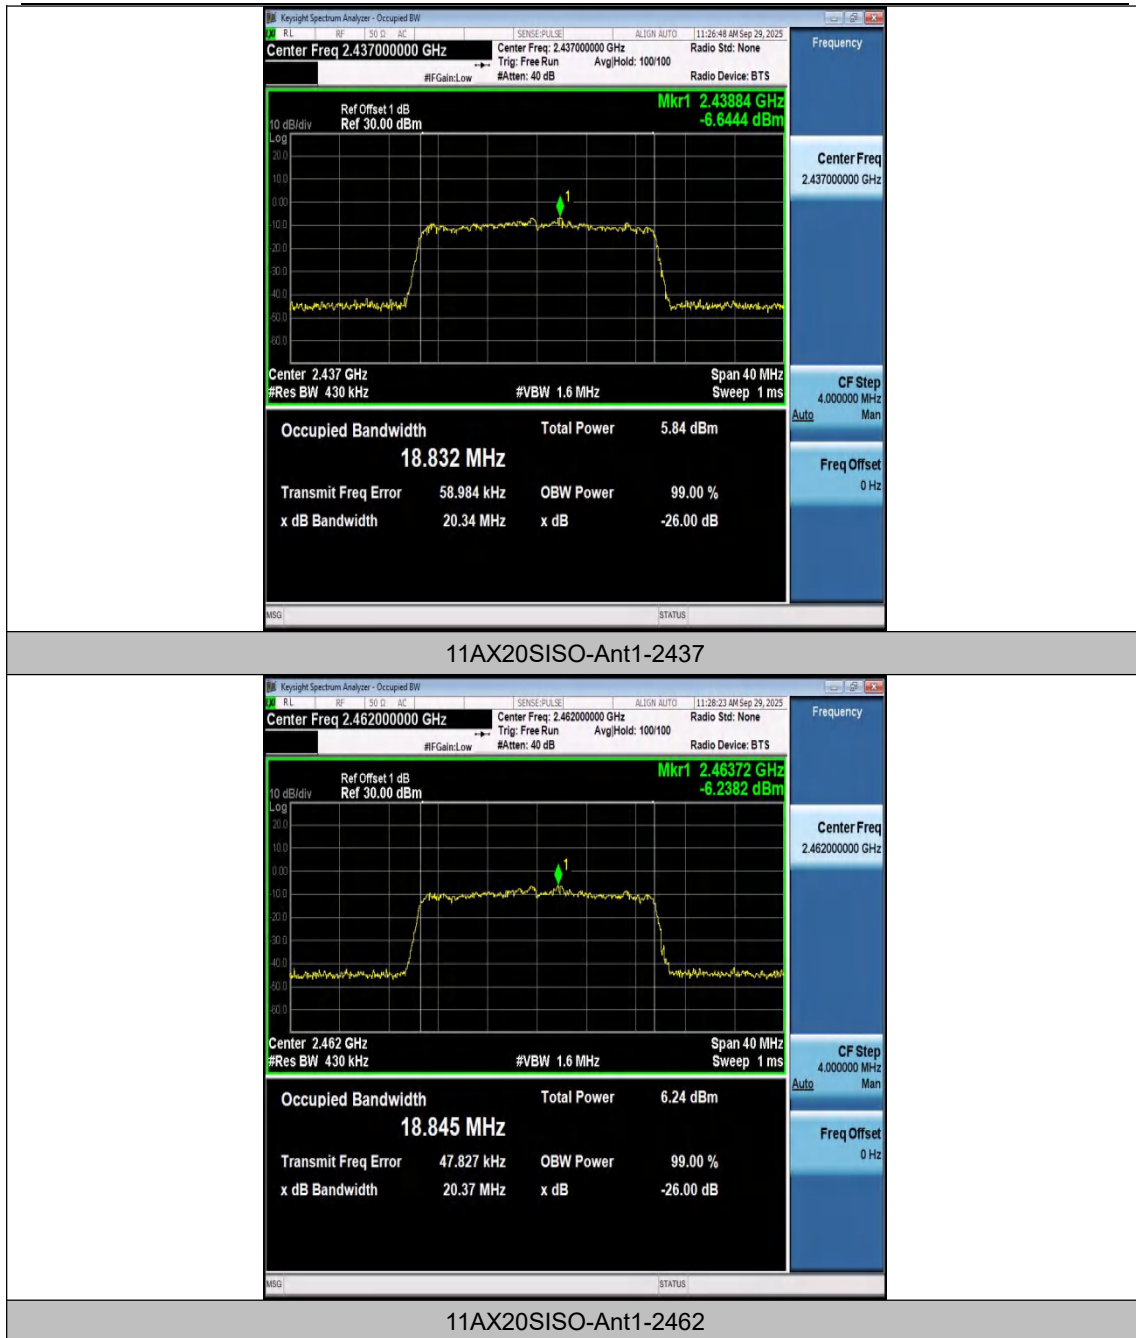

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Appendix C: Maximum conducted output power

Test Result Average

Test Mode	Antenna	Frequency [MHz]	Average power [dBm]	Duty Cycle [%]	DC Factor [dB]	Result [dBm]	Limit [dBm]	Verdict
11B	Ant1	2412	13.90	100.00	0.00	13.90	≤30.00	PASS
11B	Ant1	2437	18.46	100.00	0.00	18.46	≤30.00	PASS
11B	Ant1	2462	12.84	100.00	0.00	12.84	≤30.00	PASS
11G	Ant1	2412	13.51	100.00	0.00	13.51	≤30.00	PASS
11G	Ant1	2437	18.40	100.00	0.00	18.40	≤30.00	PASS
11G	Ant1	2462	12.38	100.00	0.00	12.38	≤30.00	PASS
11N20SISO	Ant1	2412	13.26	100.00	0.00	13.26	≤30.00	PASS
11N20SISO	Ant1	2437	18.23	100.00	0.00	18.23	≤30.00	PASS
11N20SISO	Ant1	2462	12.20	100.00	0.00	12.20	≤30.00	PASS
11AX20SISO	Ant1	2412	13.23	100.00	0.00	13.23	≤30.00	PASS
11AX20SISO	Ant1	2437	18.21	100.00	0.00	18.21	≤30.00	PASS
11AX20SISO	Ant1	2462	12.14	100.00	0.00	12.14	≤30.00	PASS

Note: The Duty Cycle Factor($10 \cdot \log(1/D)$) and cable loss are compensated in the graph.


Test Graphs Average

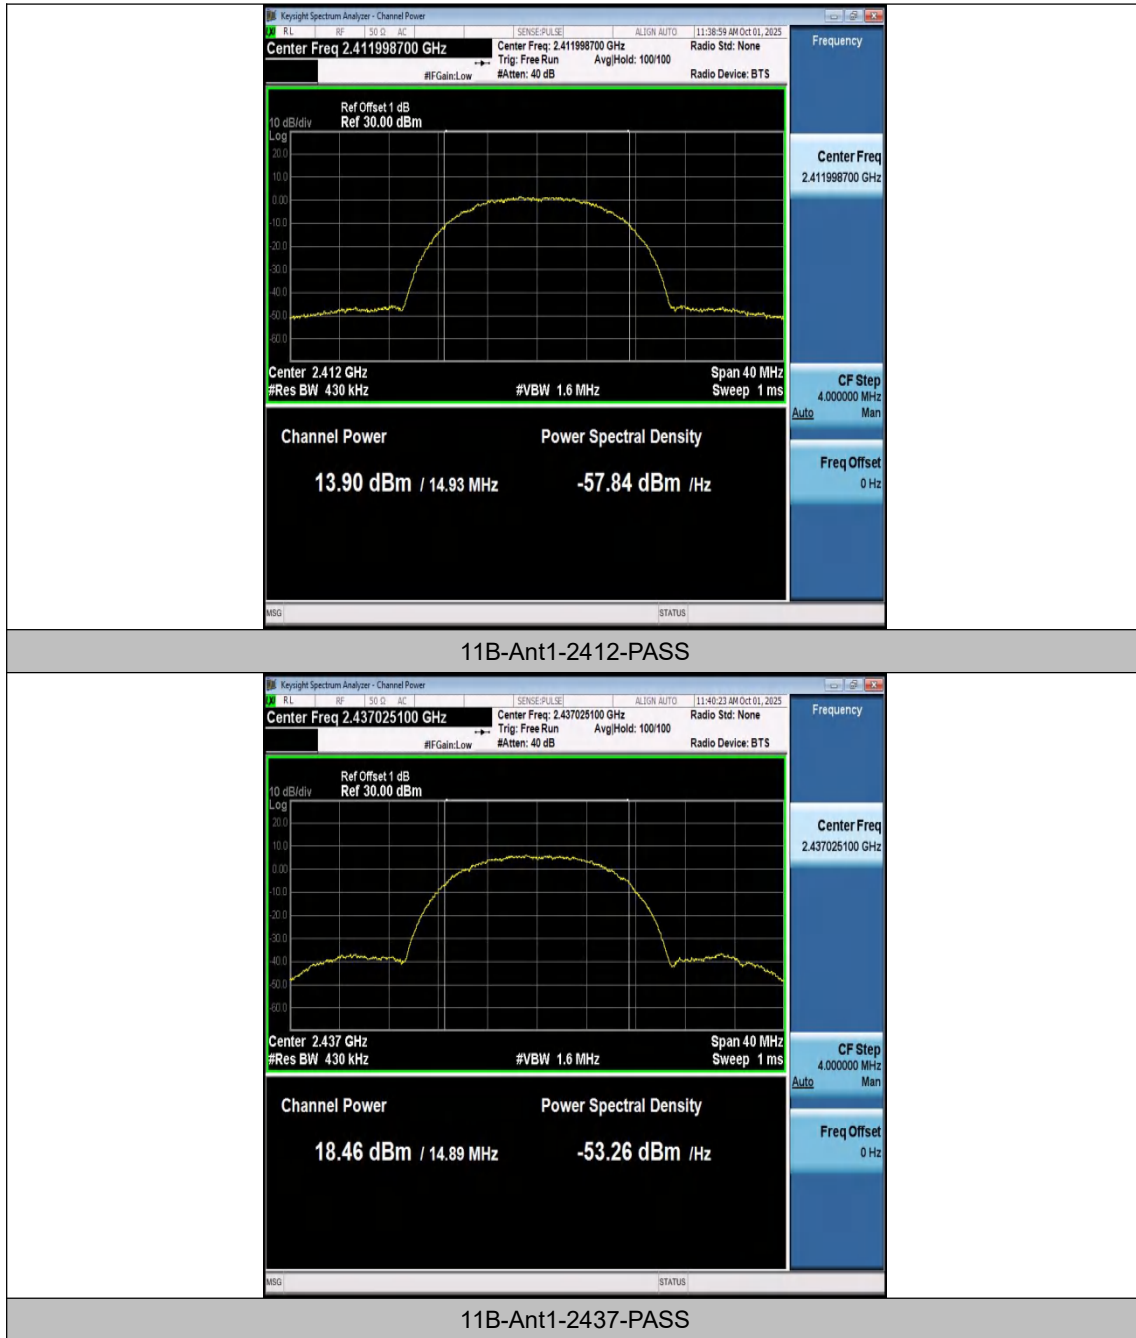

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

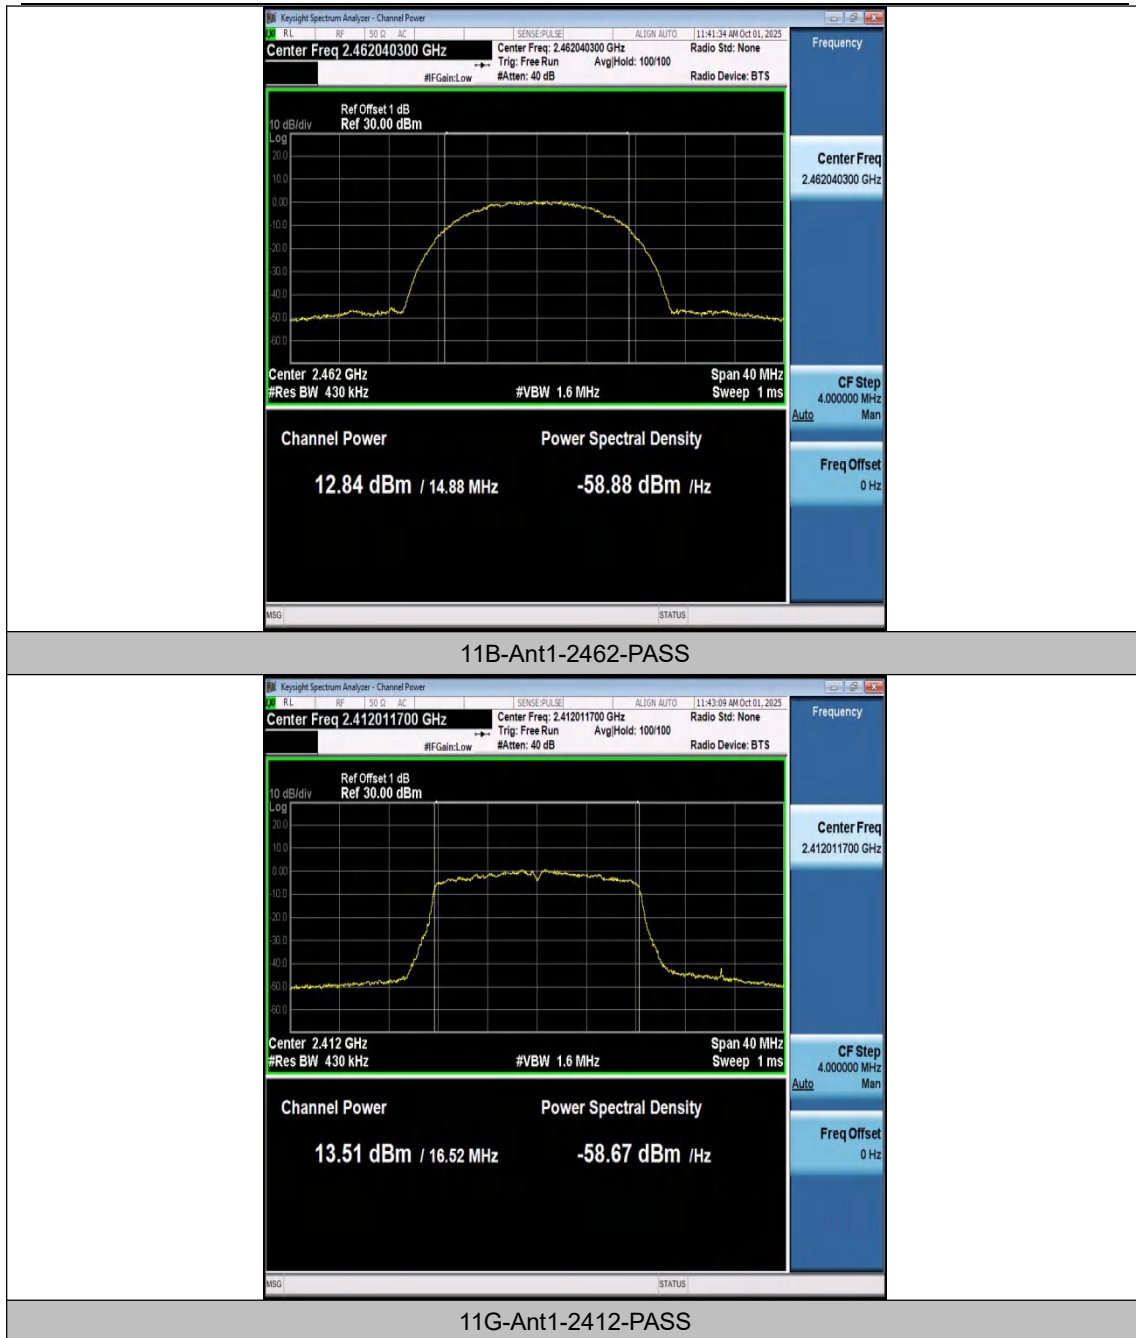

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

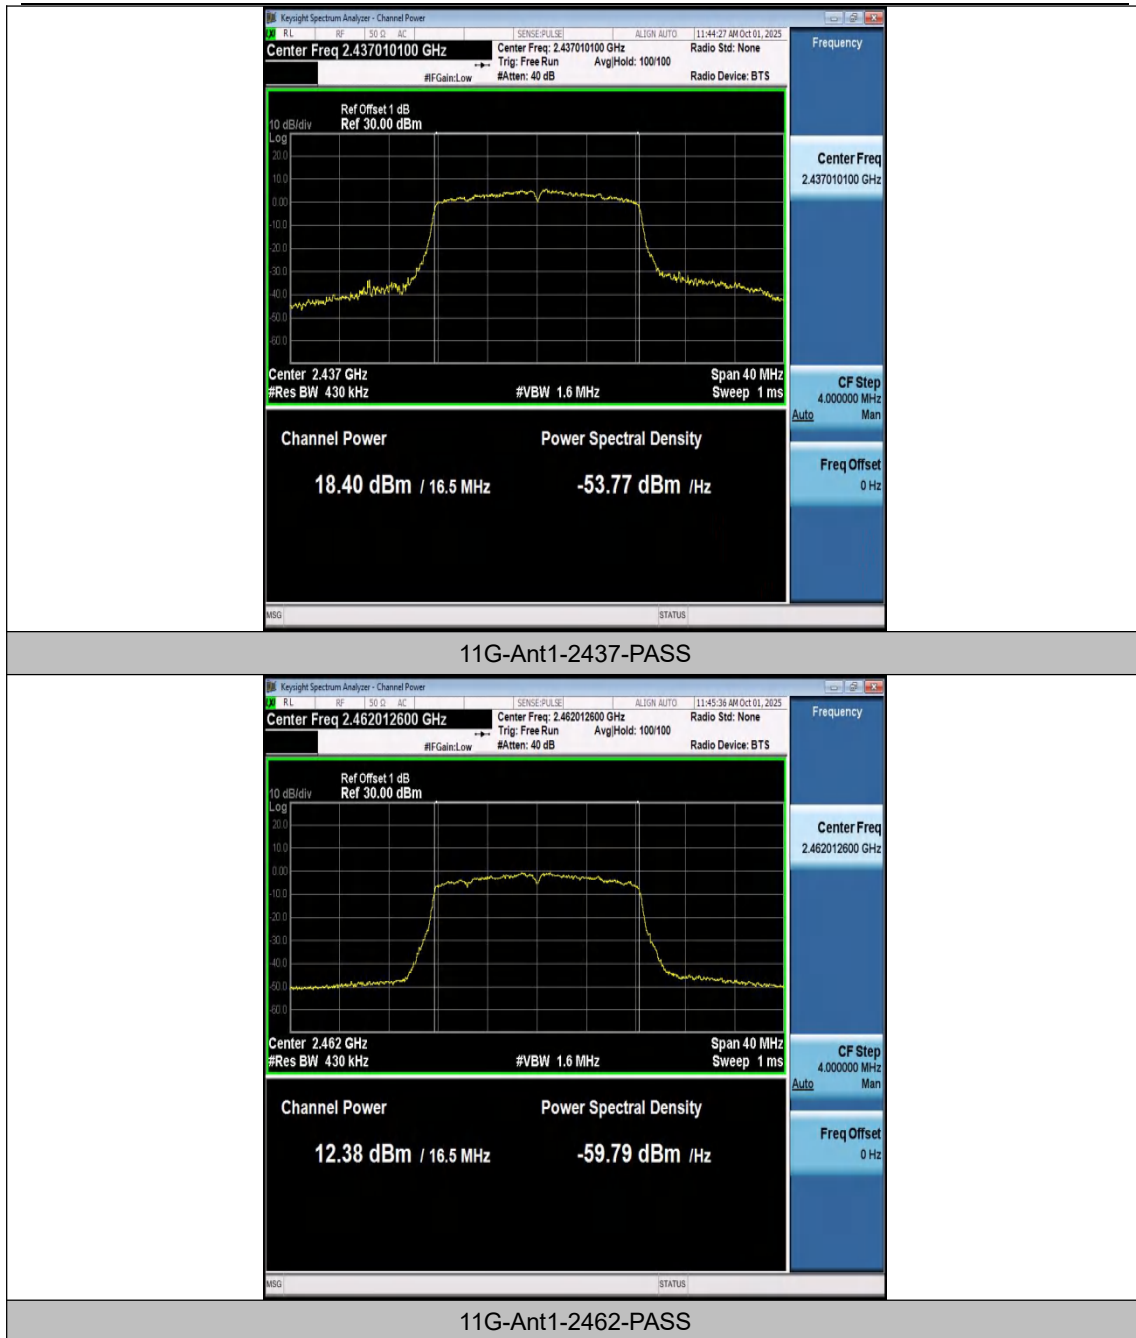

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

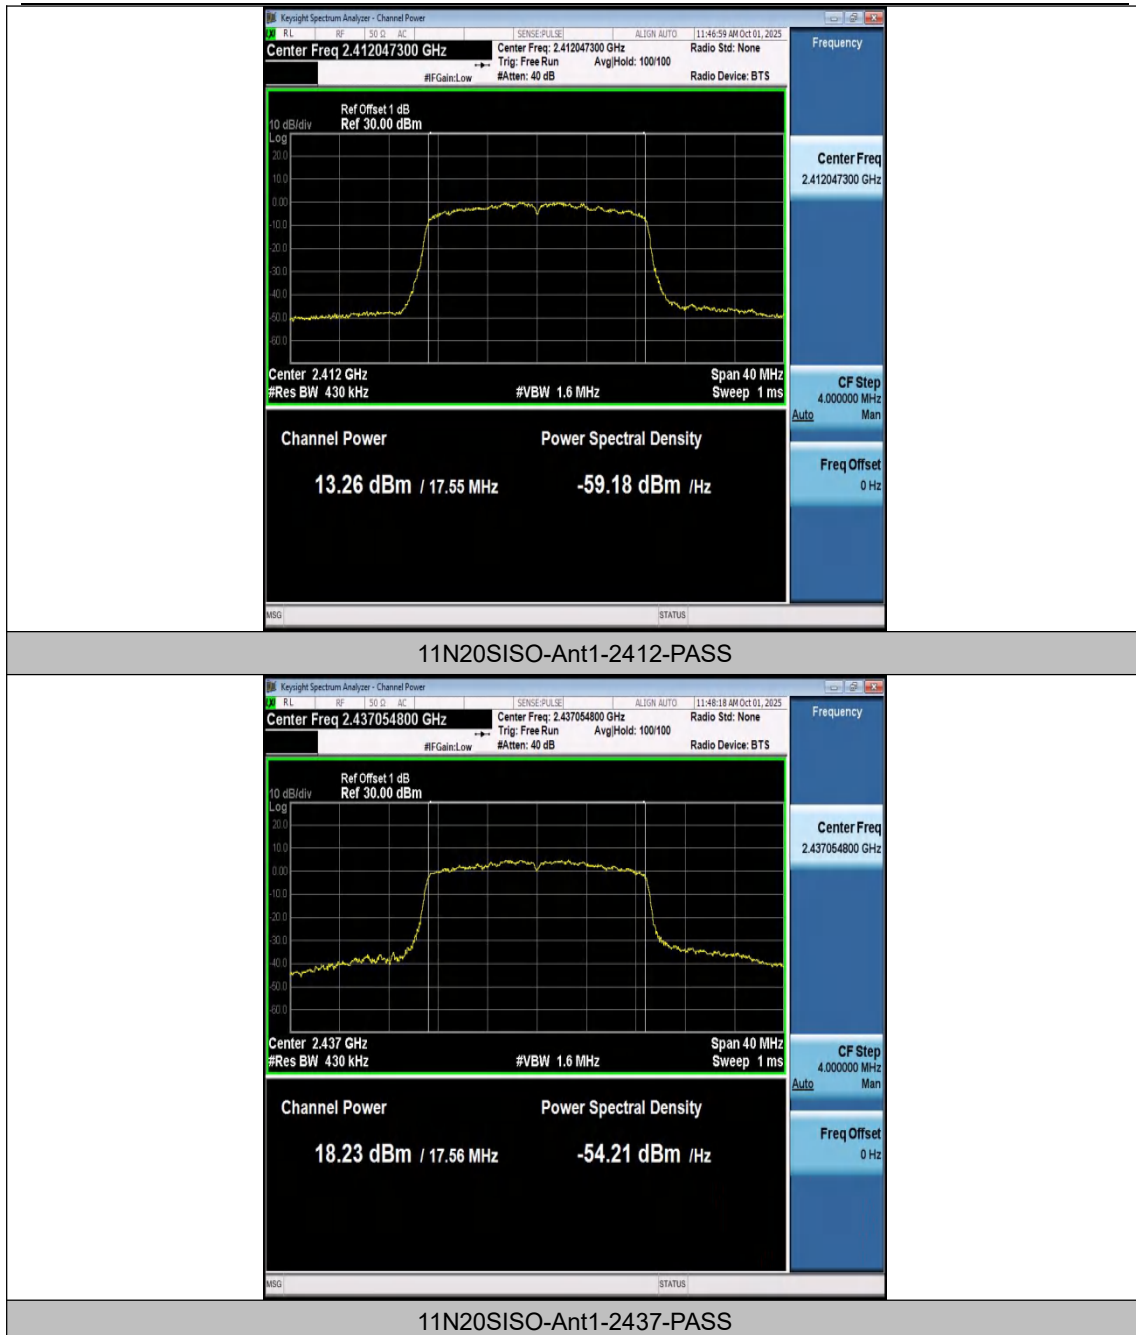

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

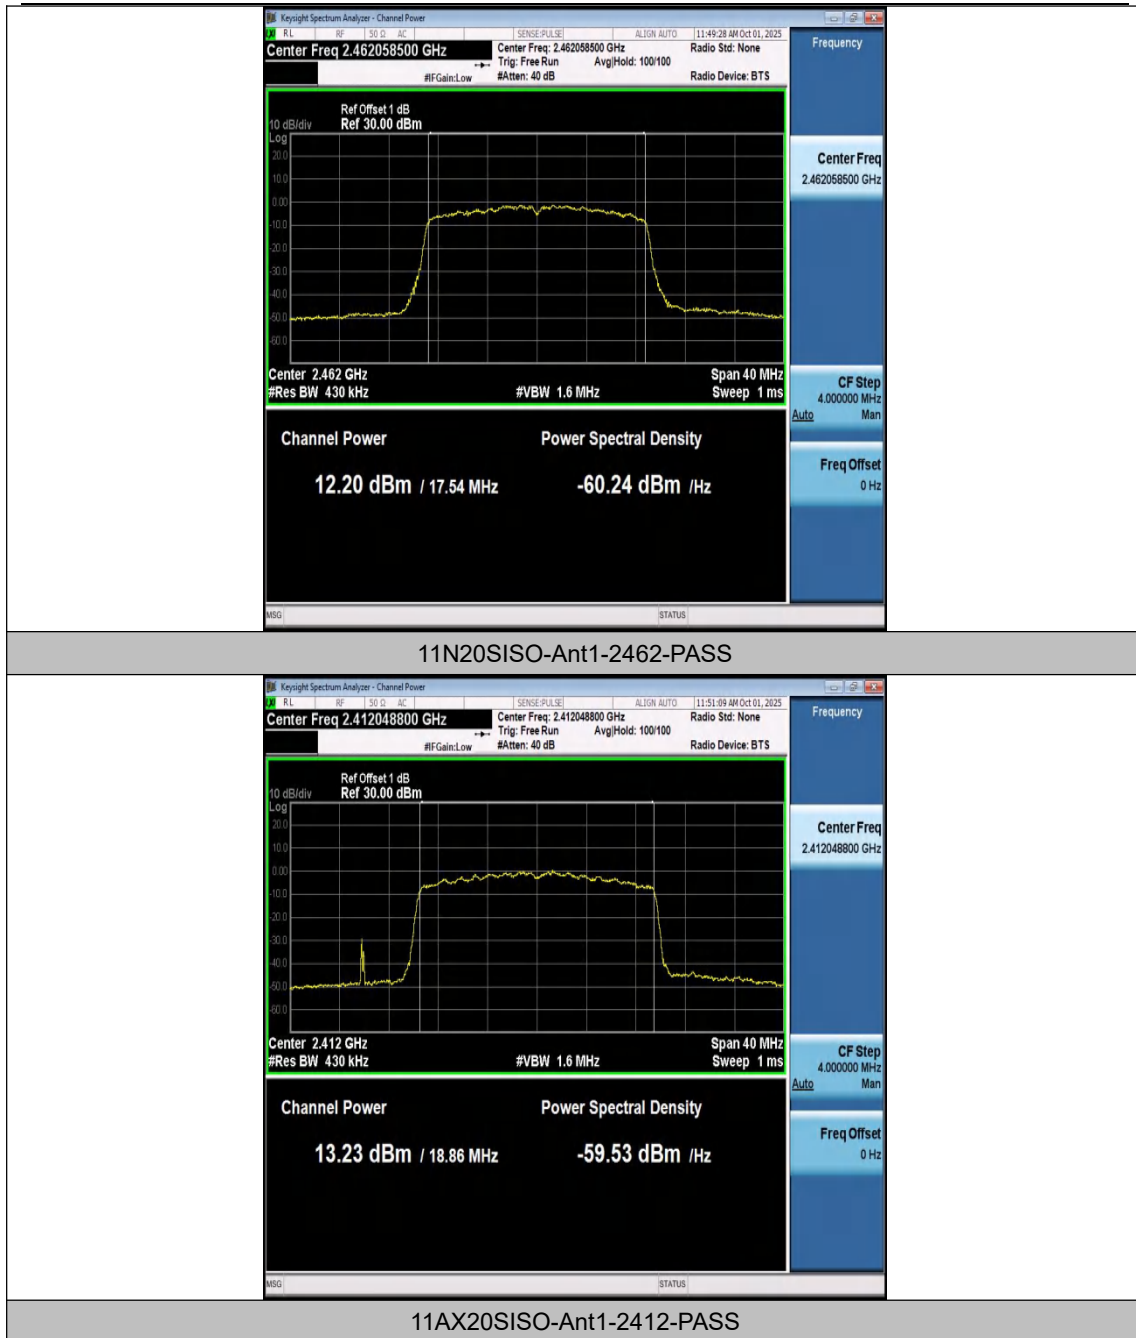

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

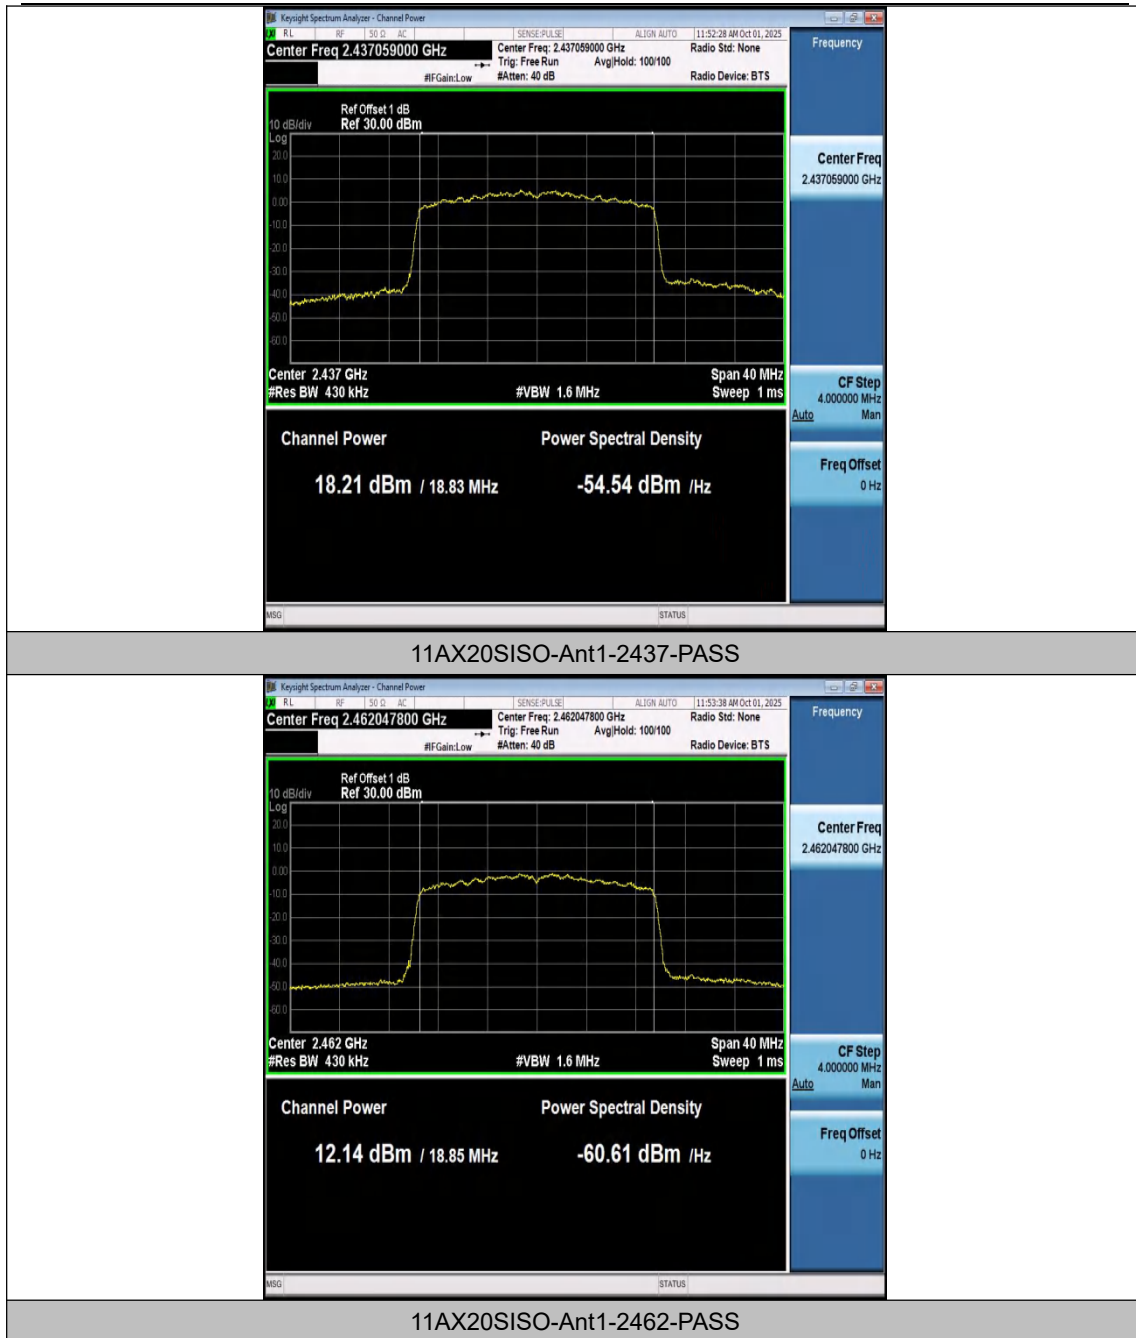

Shenzhen Anbotech Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotech.com E-mail: service@anbotech.com

Appendix D: Maximum power spectral density


Test Result

Test Mode	Antenna	Frequency[MHz]	Result[dBm/30kHz]	Limit[dBm/3kHz]	Verdict
11B	Ant1	2412	-8.66	≤8.00	PASS
11B	Ant1	2437	-3.45	≤8.00	PASS
11B	Ant1	2462	-9.73	≤8.00	PASS
11G	Ant1	2412	-6.56	≤8.00	PASS
11G	Ant1	2437	-2.01	≤8.00	PASS
11G	Ant1	2462	-7.78	≤8.00	PASS
11N20SISO	Ant1	2412	-7.33	≤8.00	PASS
11N20SISO	Ant1	2437	-2.38	≤8.00	PASS
11N20SISO	Ant1	2462	-8.00	≤8.00	PASS
11AX20SISO	Ant1	2412	-7.13	≤8.00	PASS
11AX20SISO	Ant1	2437	-2.62	≤8.00	PASS
11AX20SISO	Ant1	2462	-8.36	≤8.00	PASS

Note:

1. The Duty Cycle Factor($10 \cdot \log(1/D)$) and cable loss are compensated in the graph.


Test Graphs

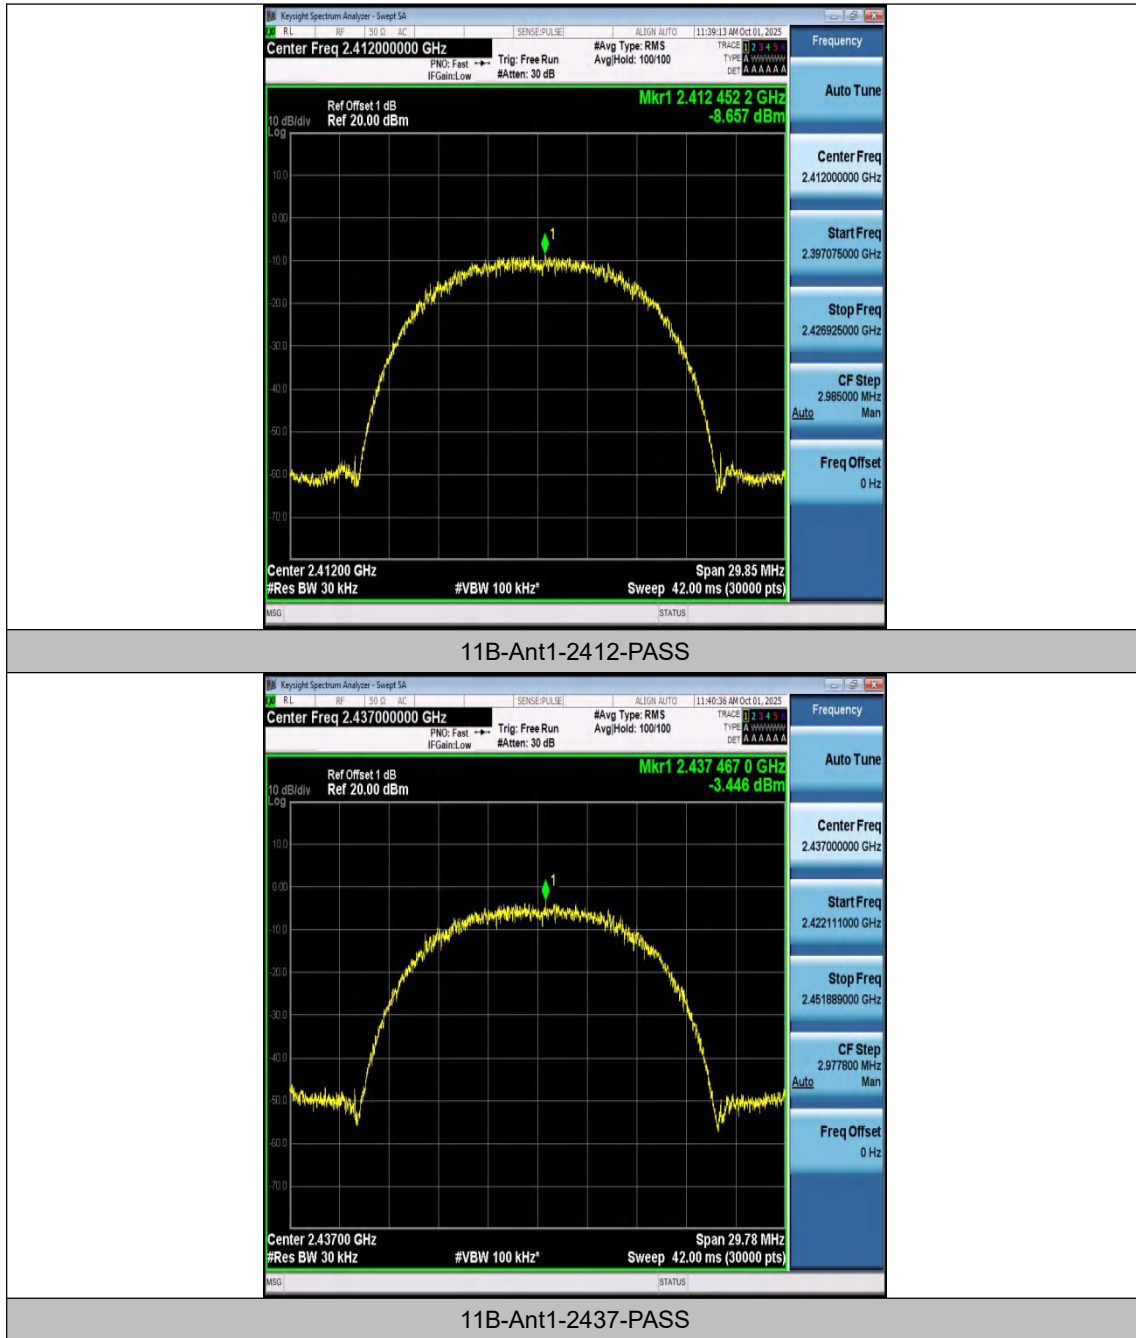


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

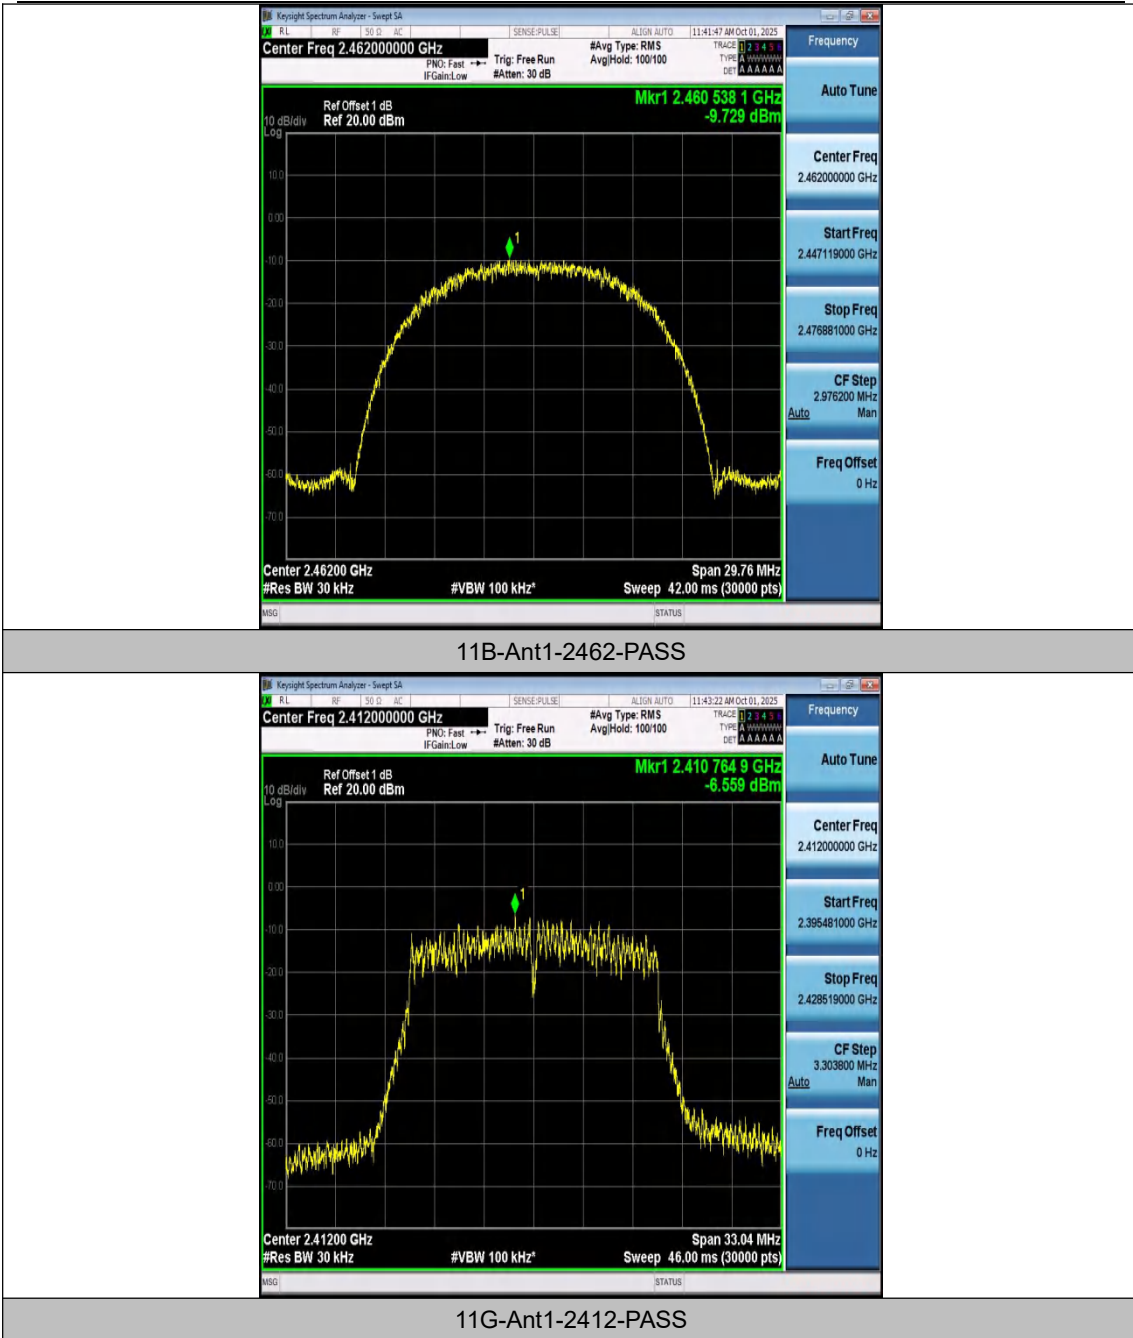


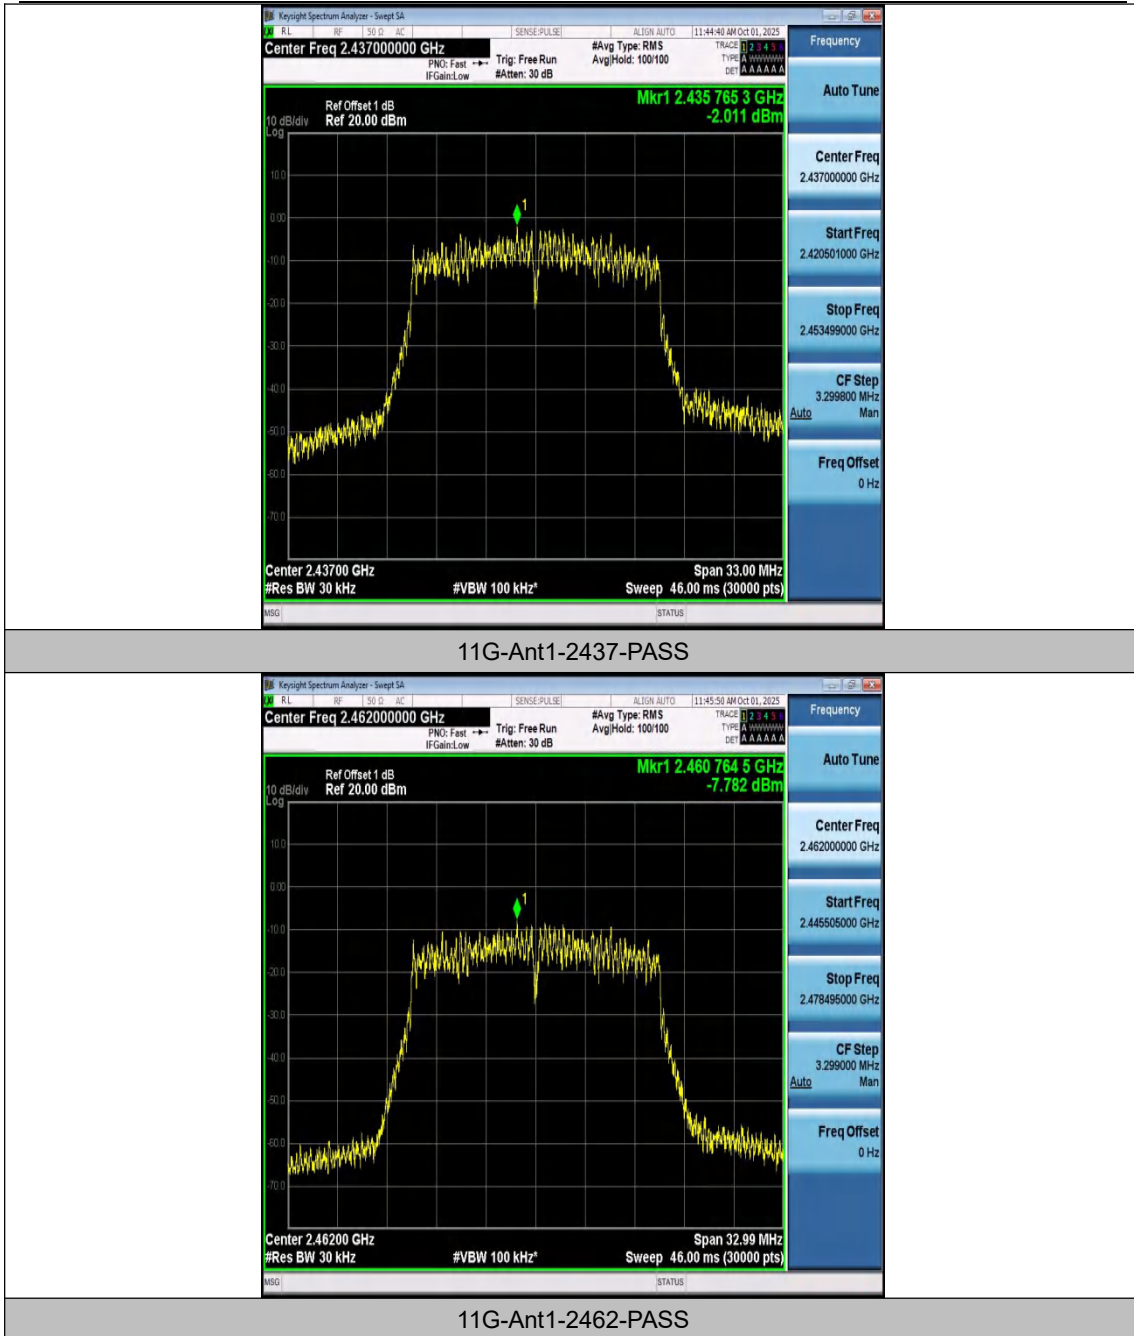

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

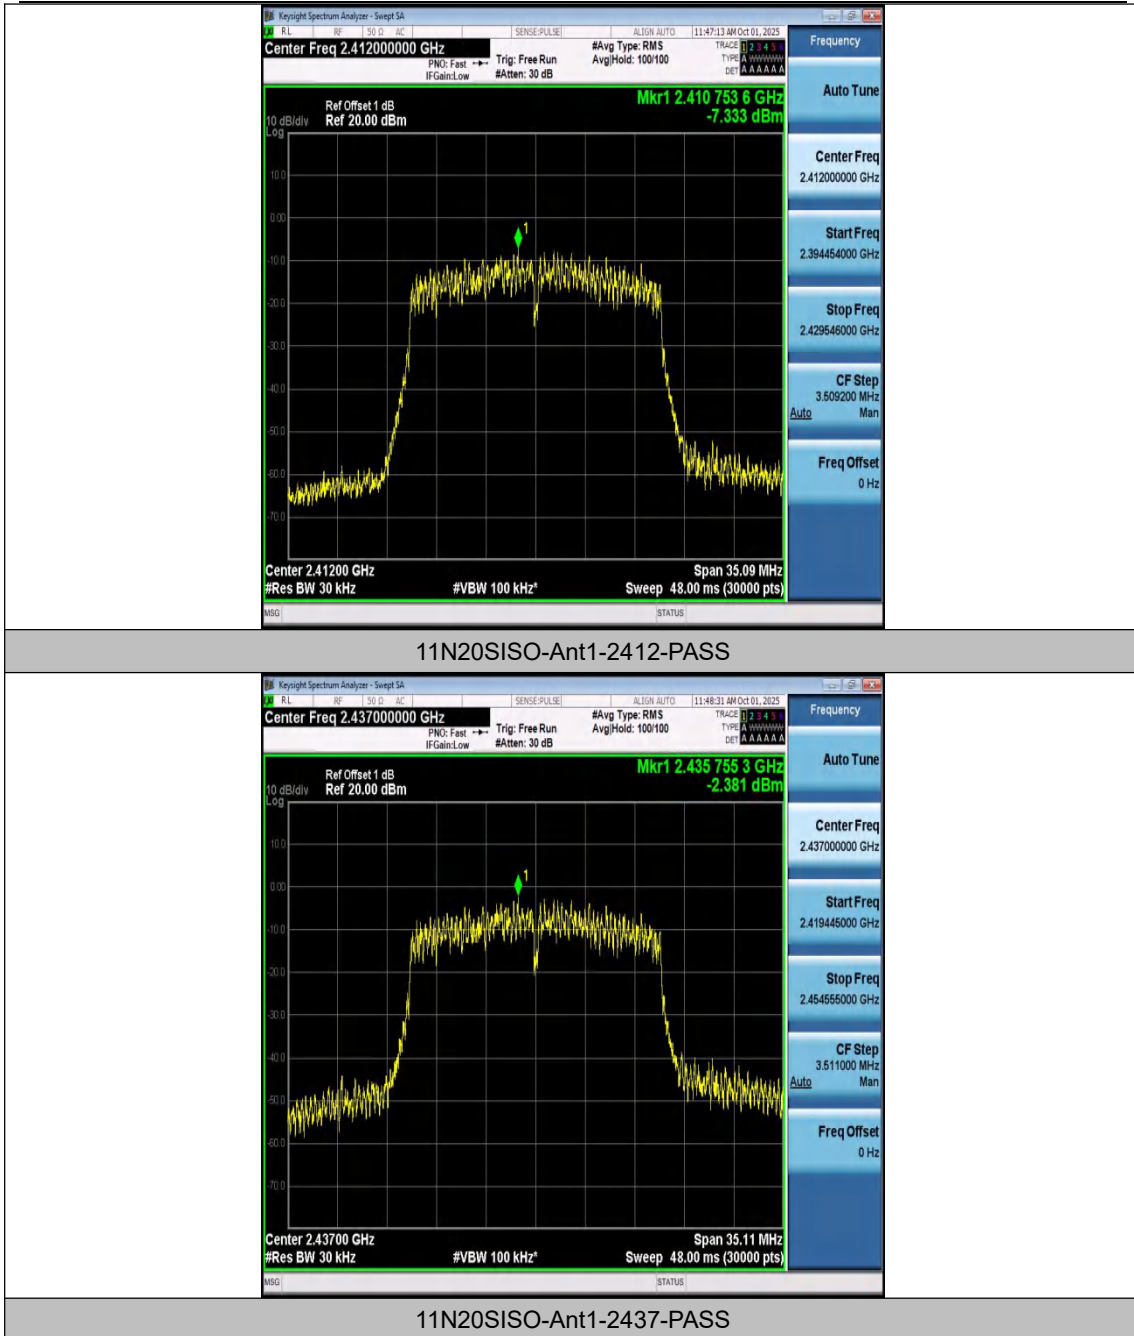

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

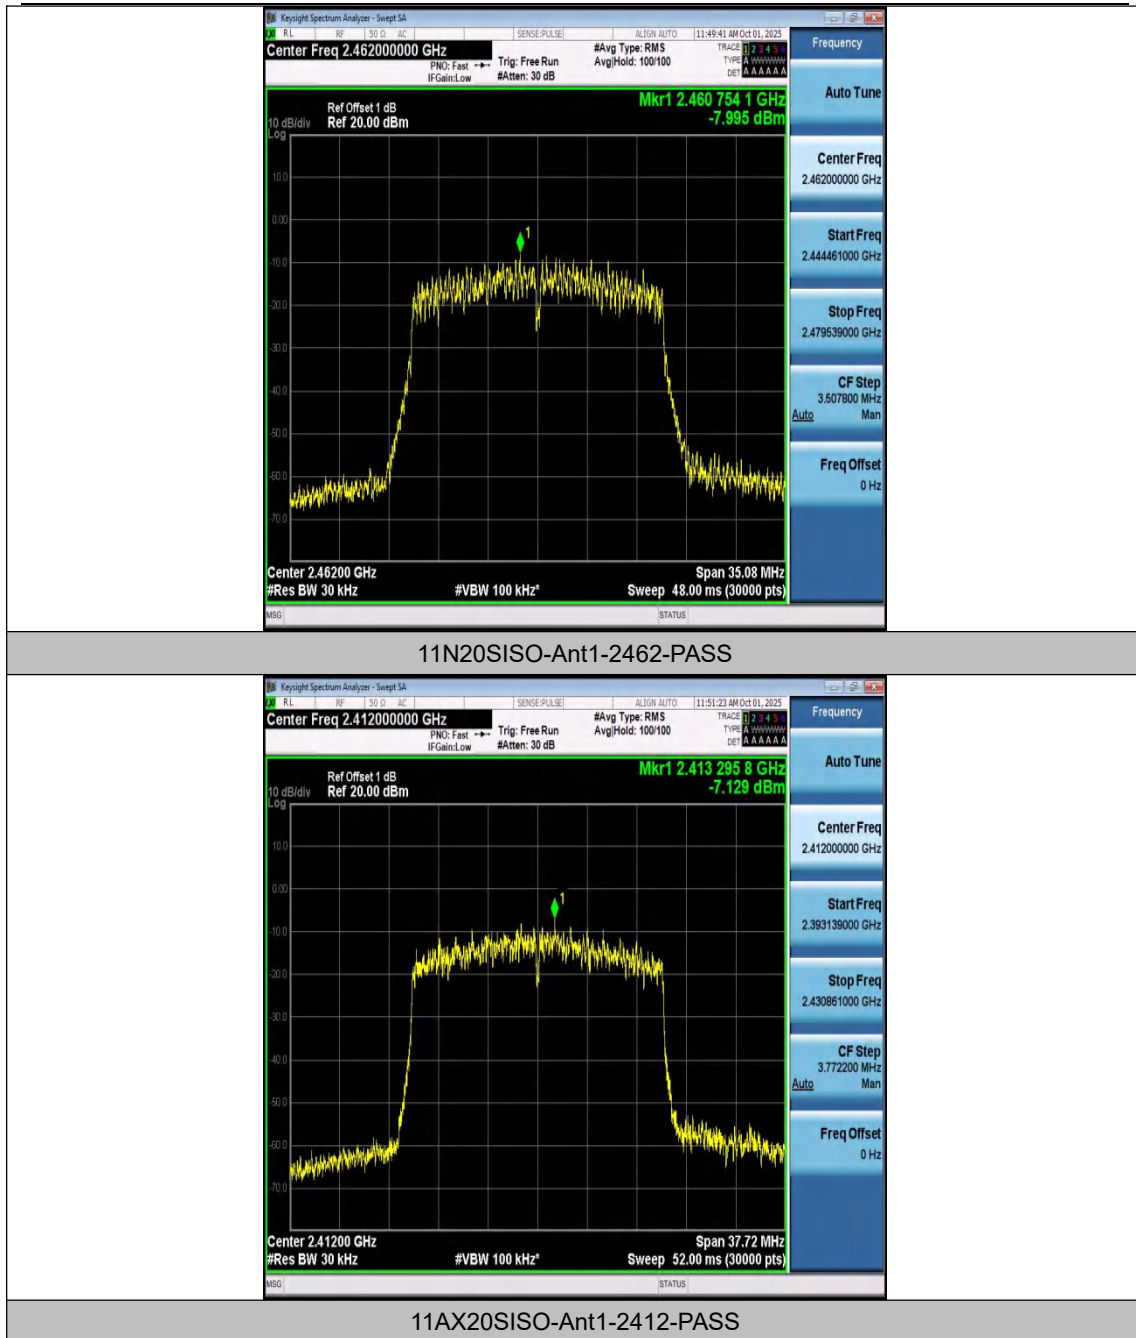

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

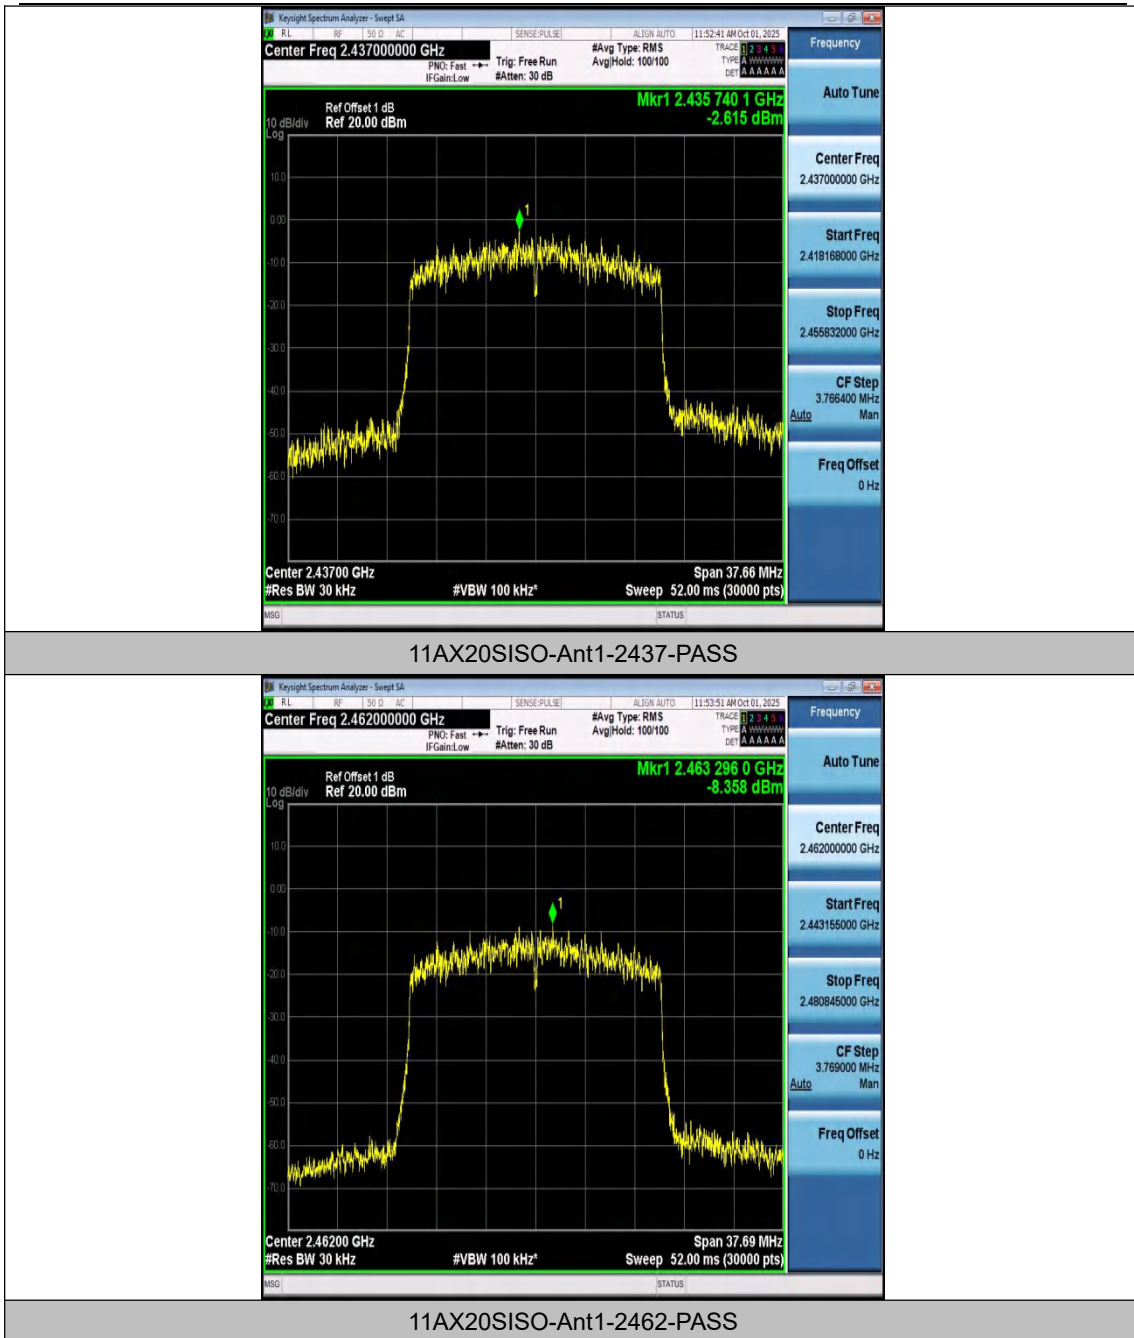

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Appendix E: Conducted Band edge


Test Result


Test Mode	Antenna	Ch. Name	Frequency [MHz]	Ref. Level[dBm]	Result[dBm]	Limit[dBm]	Verdict
11B	Ant1	Low	2412	4.22	-44.05	≤-25.78	PASS
11B	Ant1	High	2462	3.39	-54.43	≤-26.61	PASS
11G	Ant1	Low	2412	4.10	-46.28	≤-25.9	PASS
11G	Ant1	High	2462	2.88	-52.95	≤-27.12	PASS
11N20SISO	Ant1	Low	2412	4.04	-45.12	≤-25.96	PASS
11N20SISO	Ant1	High	2462	2.98	-51.49	≤-27.02	PASS
11AX20SISO	Ant1	Low	2412	3.70	-46.5	≤-26.3	PASS
11AX20SISO	Ant1	High	2462	2.63	-50.62	≤-27.37	PASS


Remark:Regarding the spurious emissions from 30MHz to 26.5GHz, the cable lose have been set in the 'offset' of the Spectrum Analyzer during the test.

Test Graphs

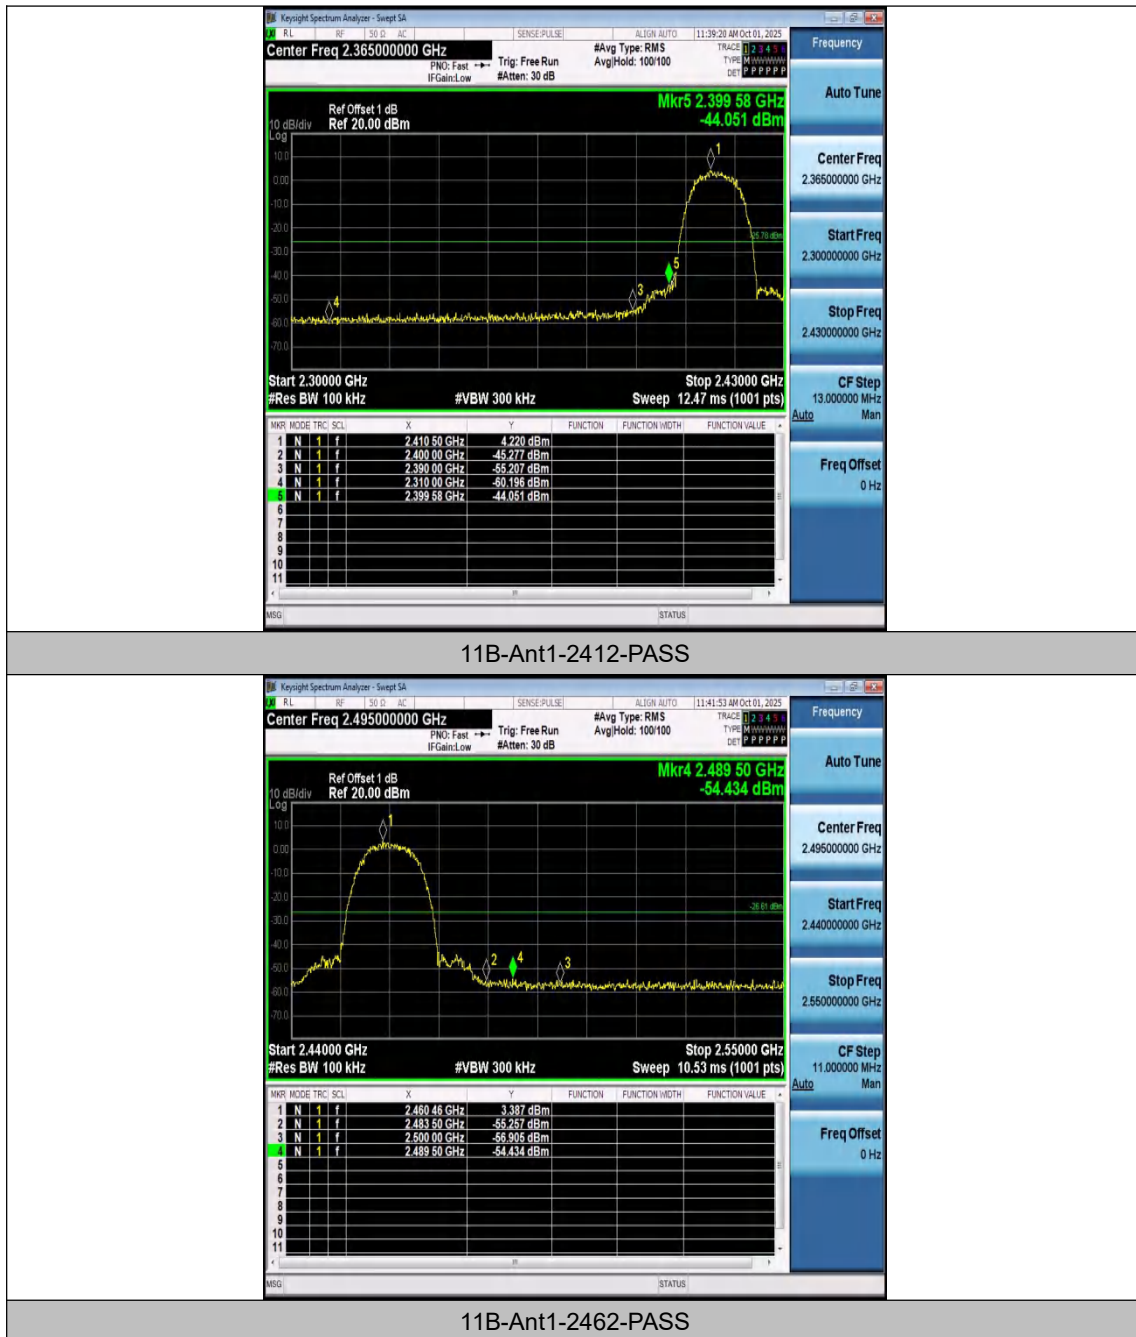

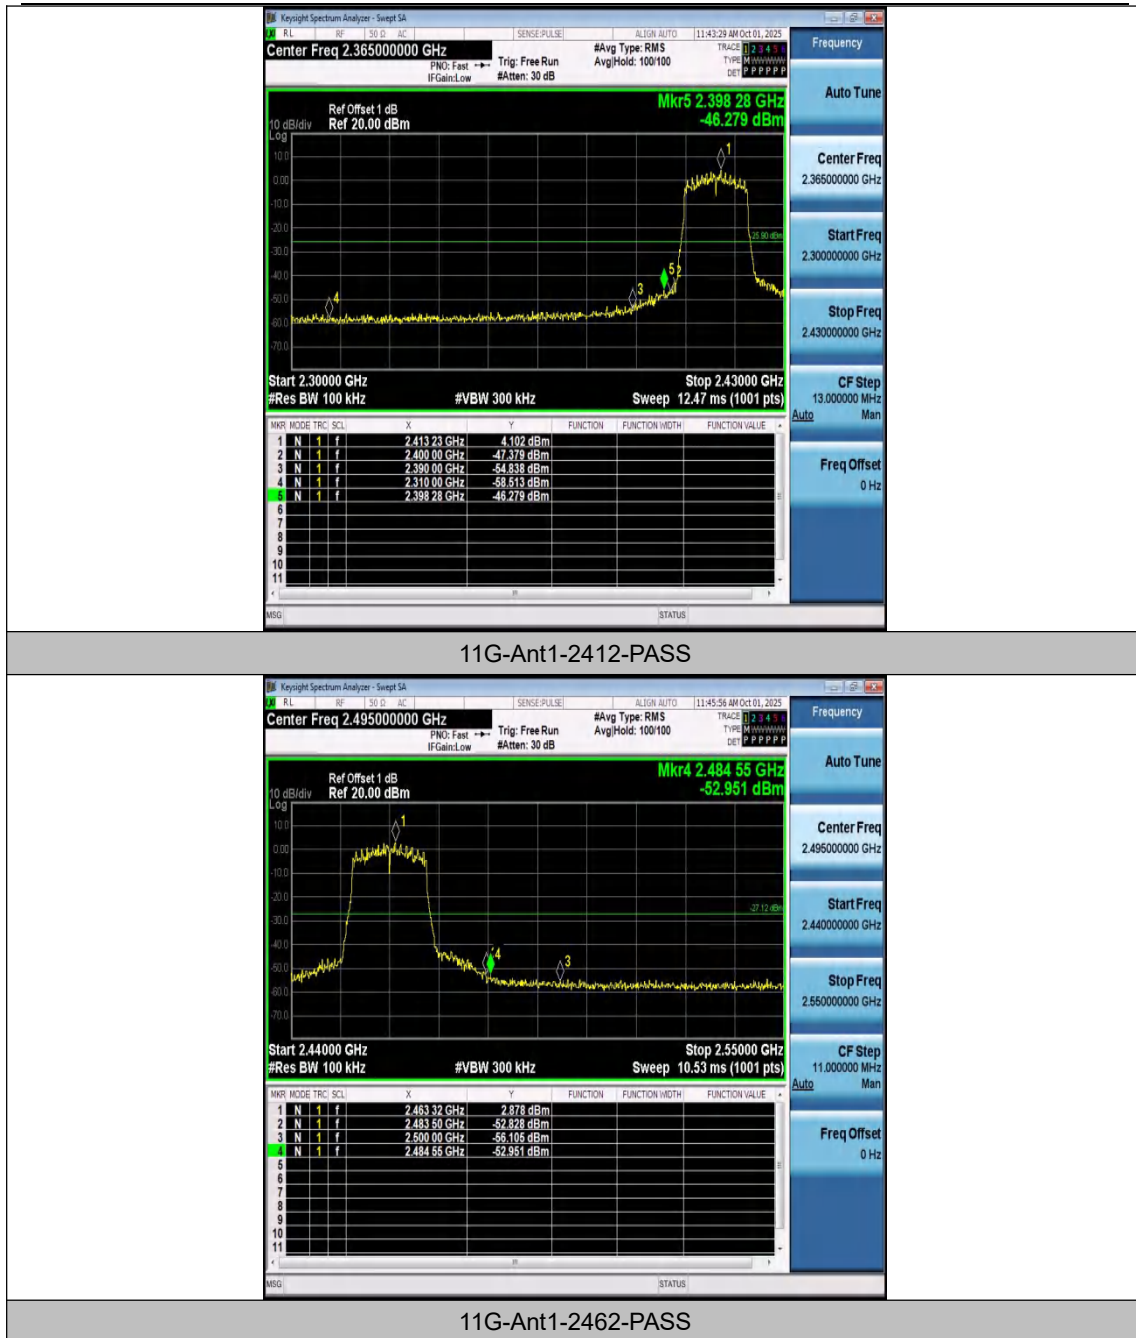

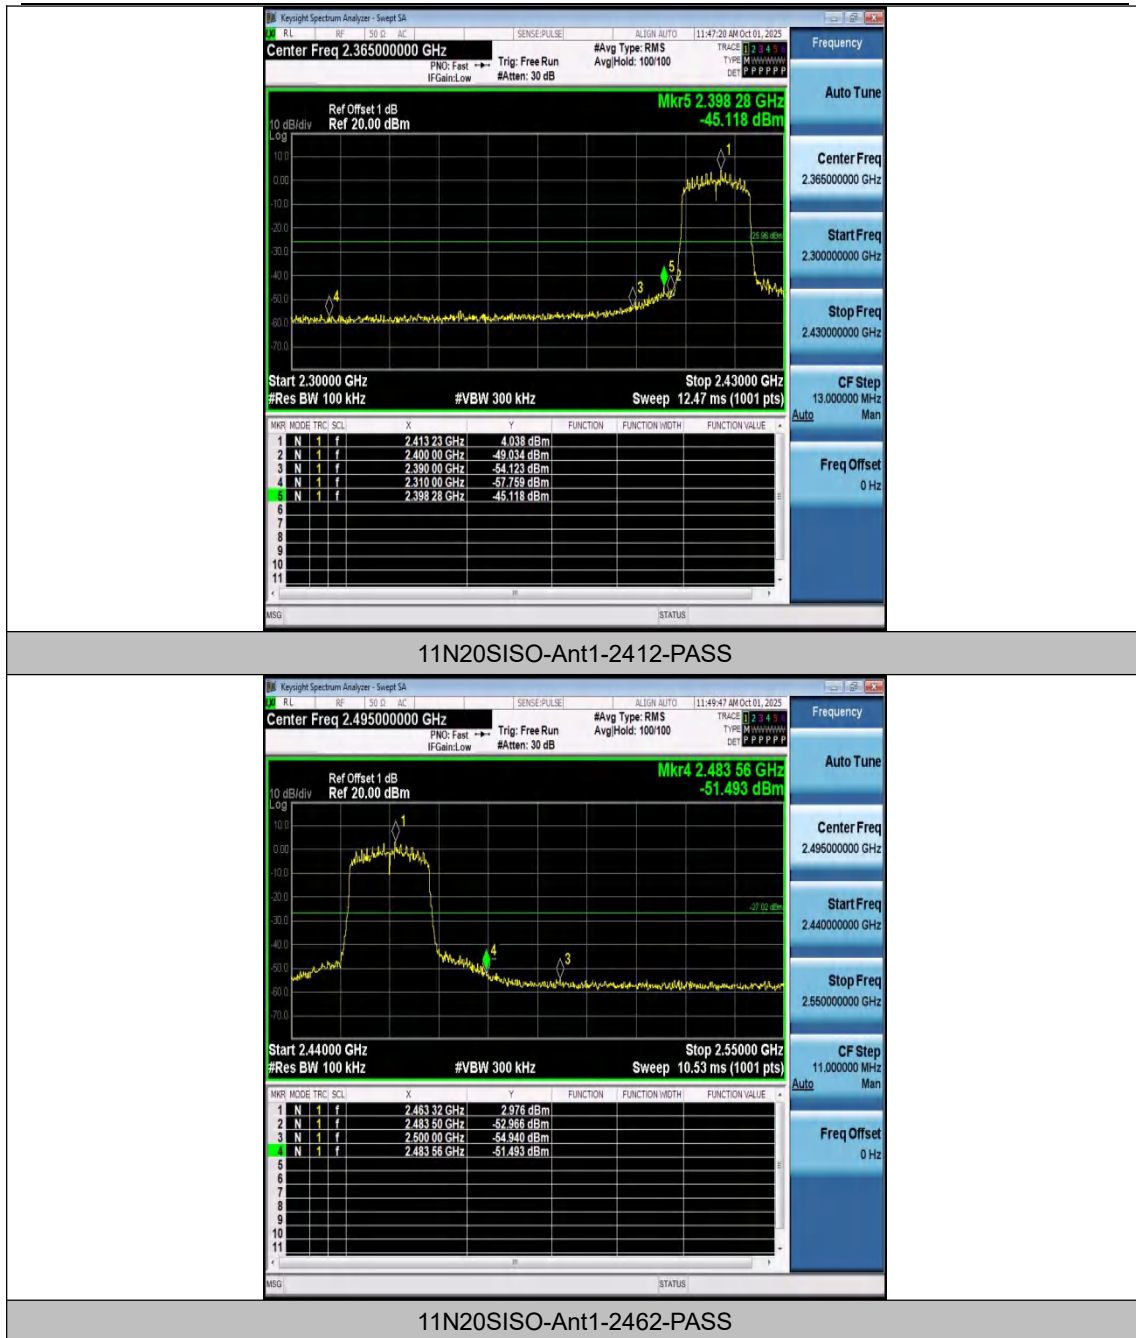

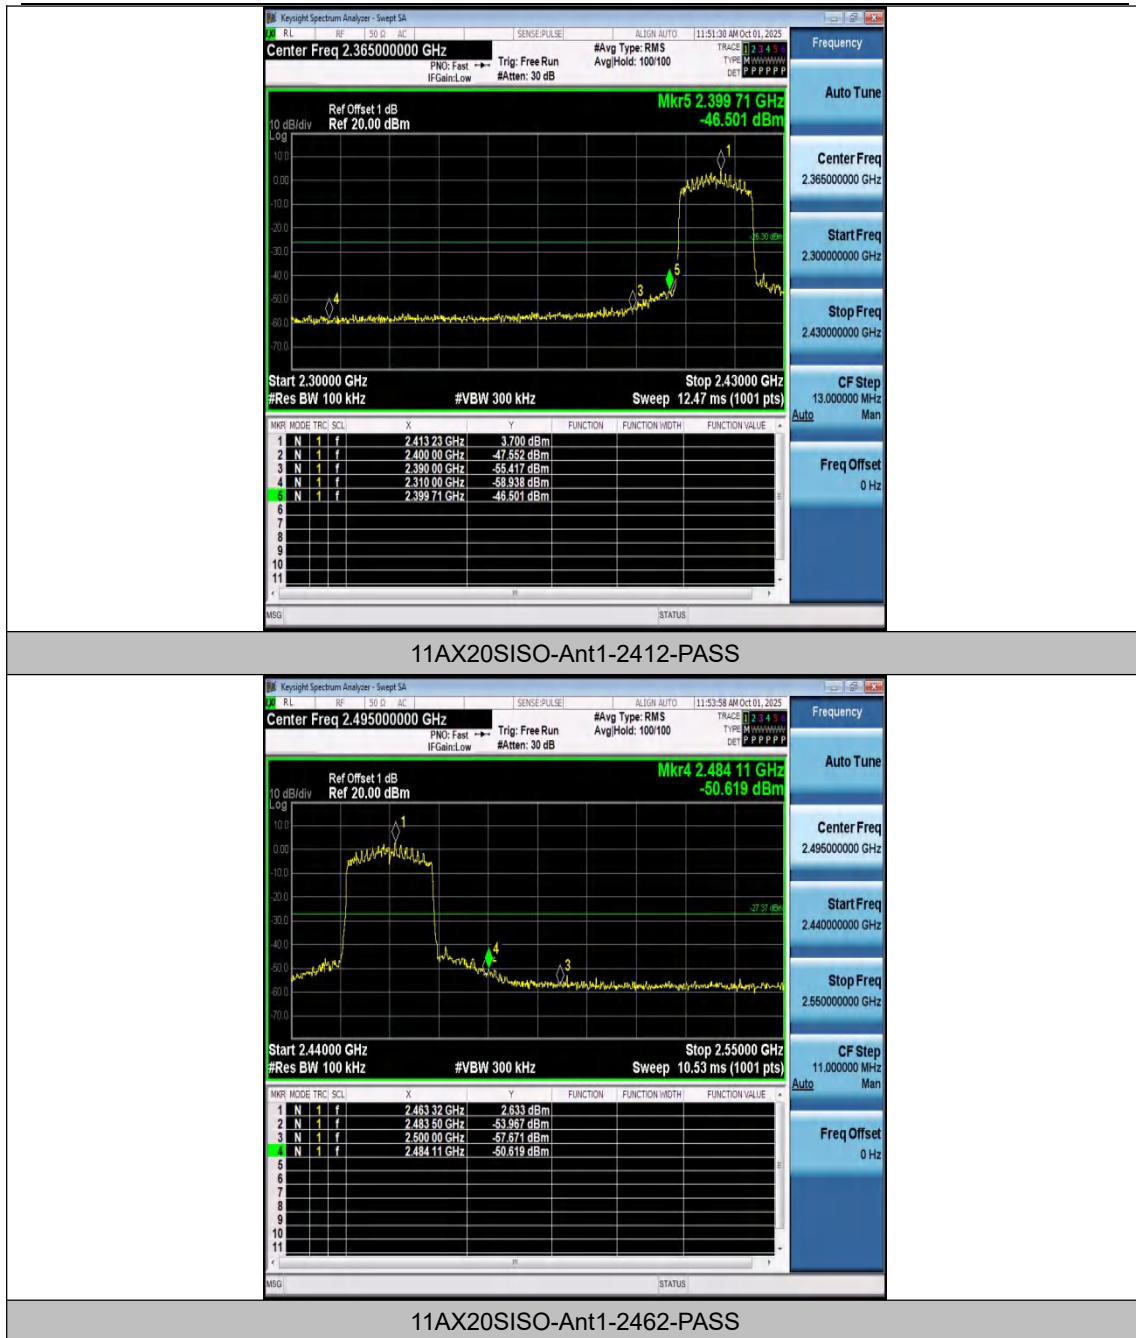


Appendix F: Conducted Spurious Emission

Test Result

Test Mode	Antenna	Frequency [MHz]	Freq. Range [Mhz]	Ref. Level [dBm]	Result [dBm]	Limit [dBm]	Verdict
11B	Ant1	2412	0~Reference	3.00	3.00	---	PASS
11B	Ant1	2412	30~1000	3.00	-68.03	≤-27	PASS
11B	Ant1	2412	1000~26500	3.00	-50.31	≤-27	PASS
11B	Ant1	2437	0~Reference	8.48	8.48	---	PASS
11B	Ant1	2437	30~1000	8.48	-68.08	≤-21.52	PASS
11B	Ant1	2437	1000~26500	8.48	-43.2	≤-21.52	PASS
11B	Ant1	2462	0~Reference	1.97	1.97	---	PASS
11B	Ant1	2462	30~1000	1.97	-55.47	≤-28.03	PASS
11B	Ant1	2462	1000~26500	1.97	-50.3	≤-28.03	PASS
11G	Ant1	2412	0~Reference	3.47	3.47	---	PASS
11G	Ant1	2412	30~1000	3.47	-67.74	≤-26.53	PASS
11G	Ant1	2412	1000~26500	3.47	-50.34	≤-26.53	PASS
11G	Ant1	2437	0~Reference	7.23	7.23	---	PASS
11G	Ant1	2437	30~1000	7.23	-67.71	≤-22.77	PASS
11G	Ant1	2437	1000~26500	7.23	-50.09	≤-22.77	PASS
11G	Ant1	2462	0~Reference	1.22	1.22	---	PASS
11G	Ant1	2462	30~1000	1.22	-67.91	≤-28.78	PASS
11G	Ant1	2462	1000~26500	1.22	-49.94	≤-28.78	PASS
11N20SISO	Ant1	2412	0~Reference	3.52	3.52	---	PASS
11N20SISO	Ant1	2412	30~1000	3.52	-68.28	≤-26.48	PASS
11N20SISO	Ant1	2412	1000~26500	3.52	-50.34	≤-26.48	PASS
11N20SISO	Ant1	2437	0~Reference	8.94	8.94	---	PASS
11N20SISO	Ant1	2437	30~1000	8.94	-53.7	≤-21.06	PASS
11N20SISO	Ant1	2437	1000~26500	8.94	-50.73	≤-21.06	PASS
11N20SISO	Ant1	2462	0~Reference	2.32	2.32	---	PASS
11N20SISO	Ant1	2462	30~1000	2.32	-47.74	≤-27.68	PASS
11N20SISO	Ant1	2462	1000~26500	2.32	-49.79	≤-27.68	PASS
11AX20SISO	Ant1	2412	0~Reference	3.09	3.09	---	PASS
11AX20SISO	Ant1	2412	30~1000	3.09	-41.6	≤-26.91	PASS
11AX20SISO	Ant1	2412	1000~26500	3.09	-49.51	≤-26.91	PASS
11AX20SISO	Ant1	2437	0~Reference	8.63	8.63	---	PASS
11AX20SISO	Ant1	2437	30~1000	8.63	-45.24	≤-21.37	PASS
11AX20SISO	Ant1	2437	1000~26500	8.63	-50.23	≤-21.37	PASS
11AX20SISO	Ant1	2462	0~Reference	1.46	1.46	---	PASS
11AX20SISO	Ant1	2462	30~1000	1.46	-67.21	≤-28.54	PASS
11AX20SISO	Ant1	2462	1000~26500	1.46	-49.52	≤-28.54	PASS

Remark:Regarding the spurious emissions from 30MHz to 26.5GHz, the cable lose have been set in the 'Input Correction' of the Spectrum Analyzer during the test.


Test Graphs

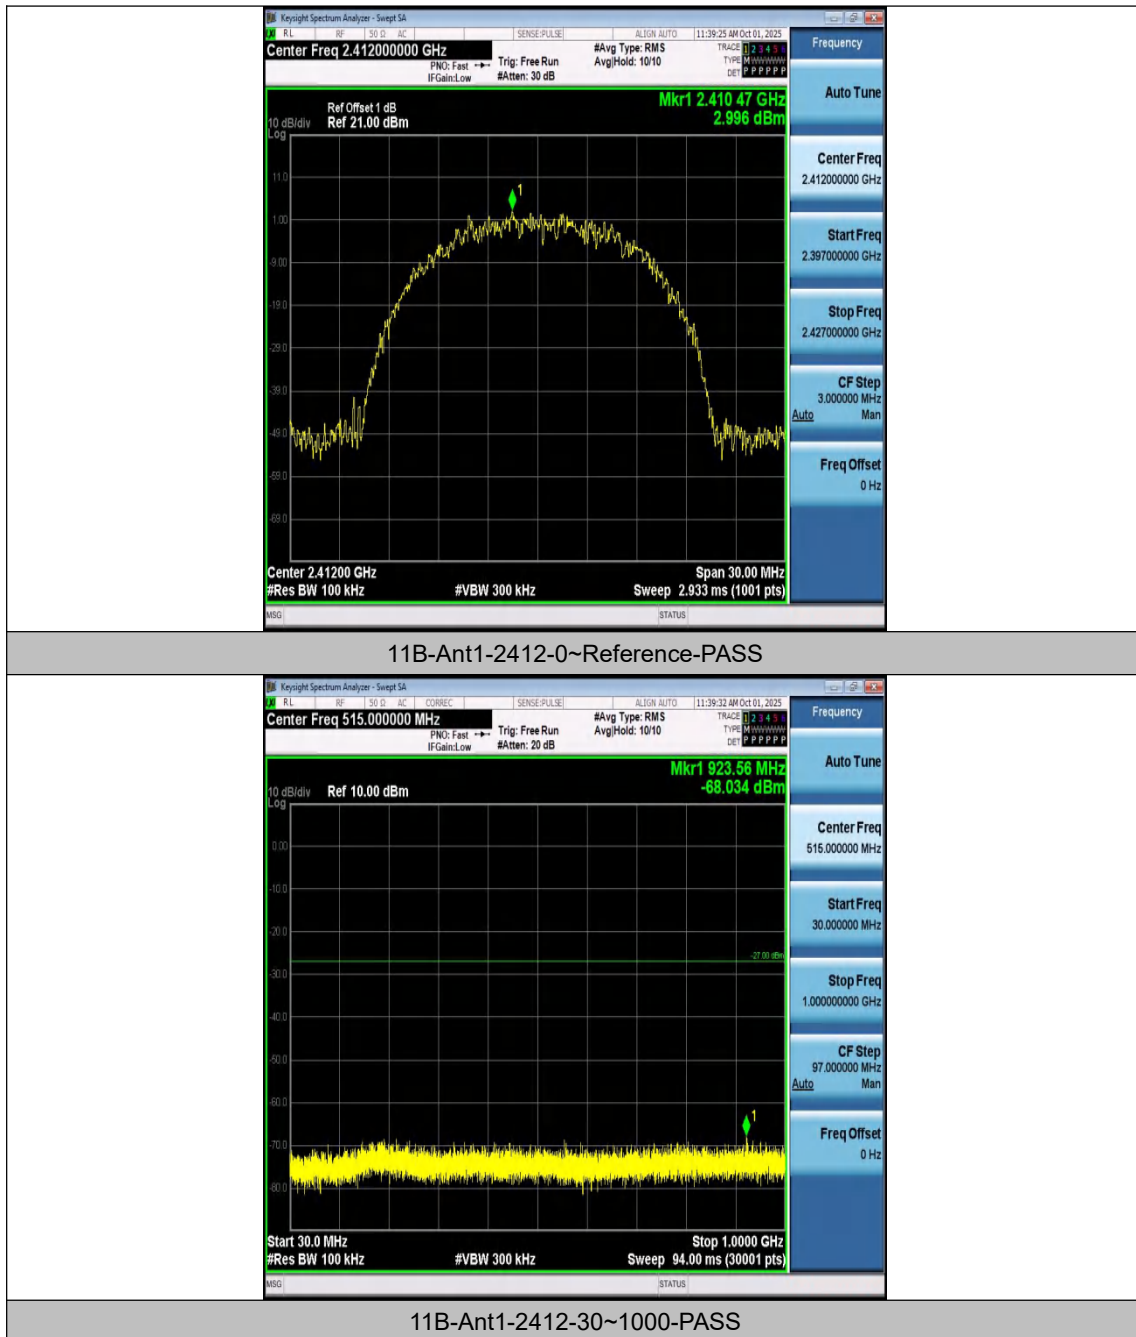

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

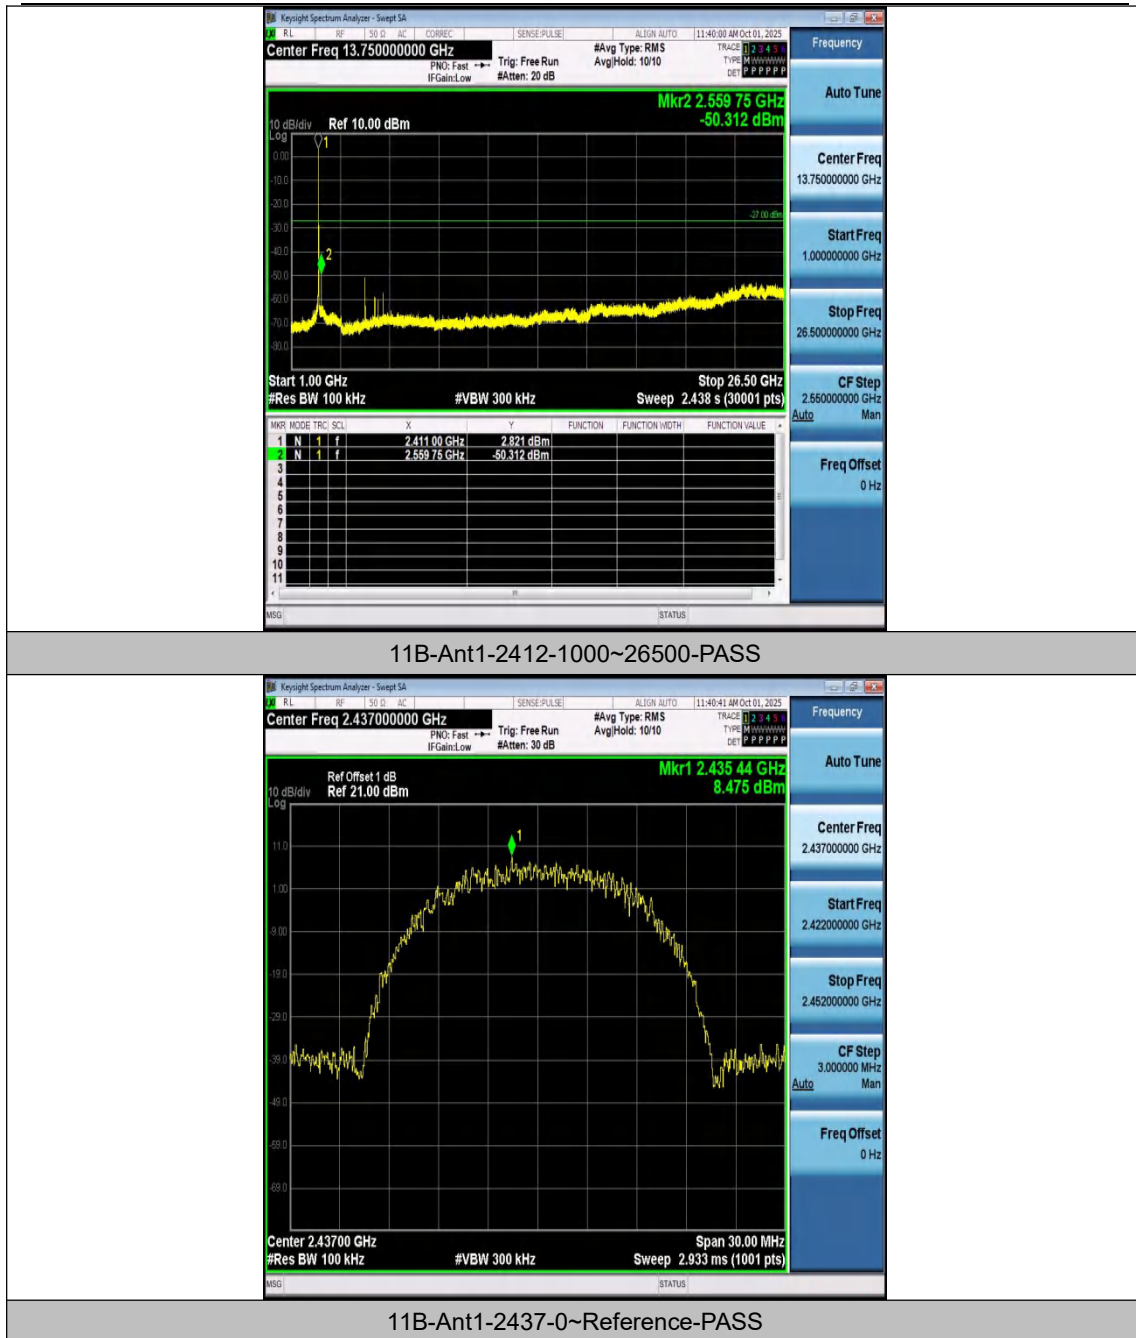

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

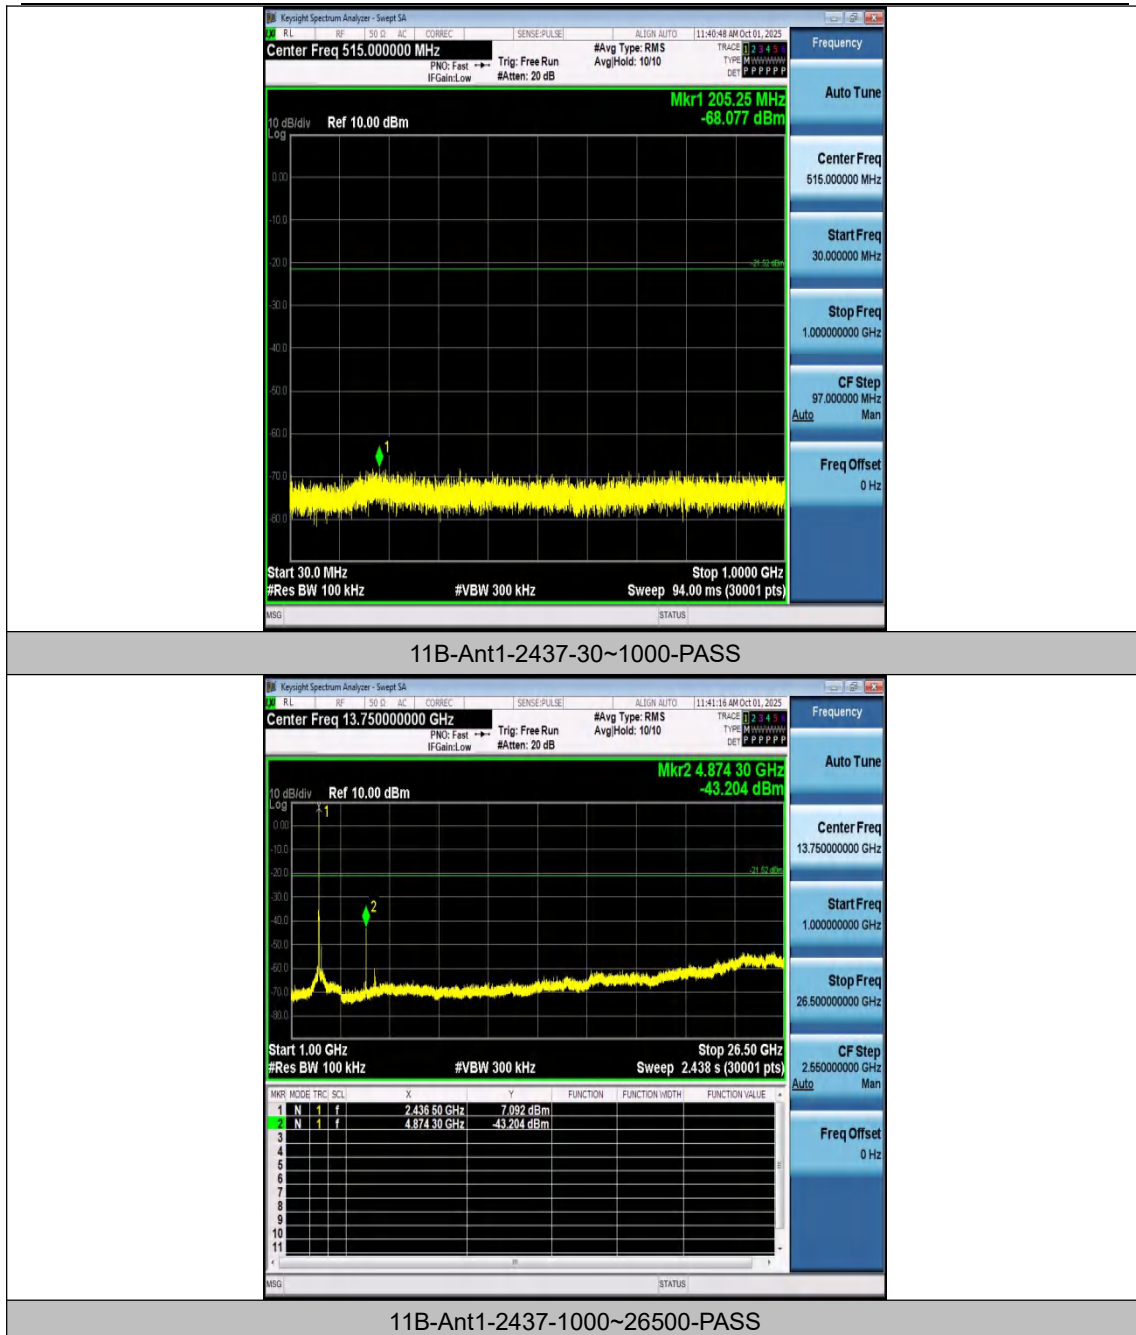

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

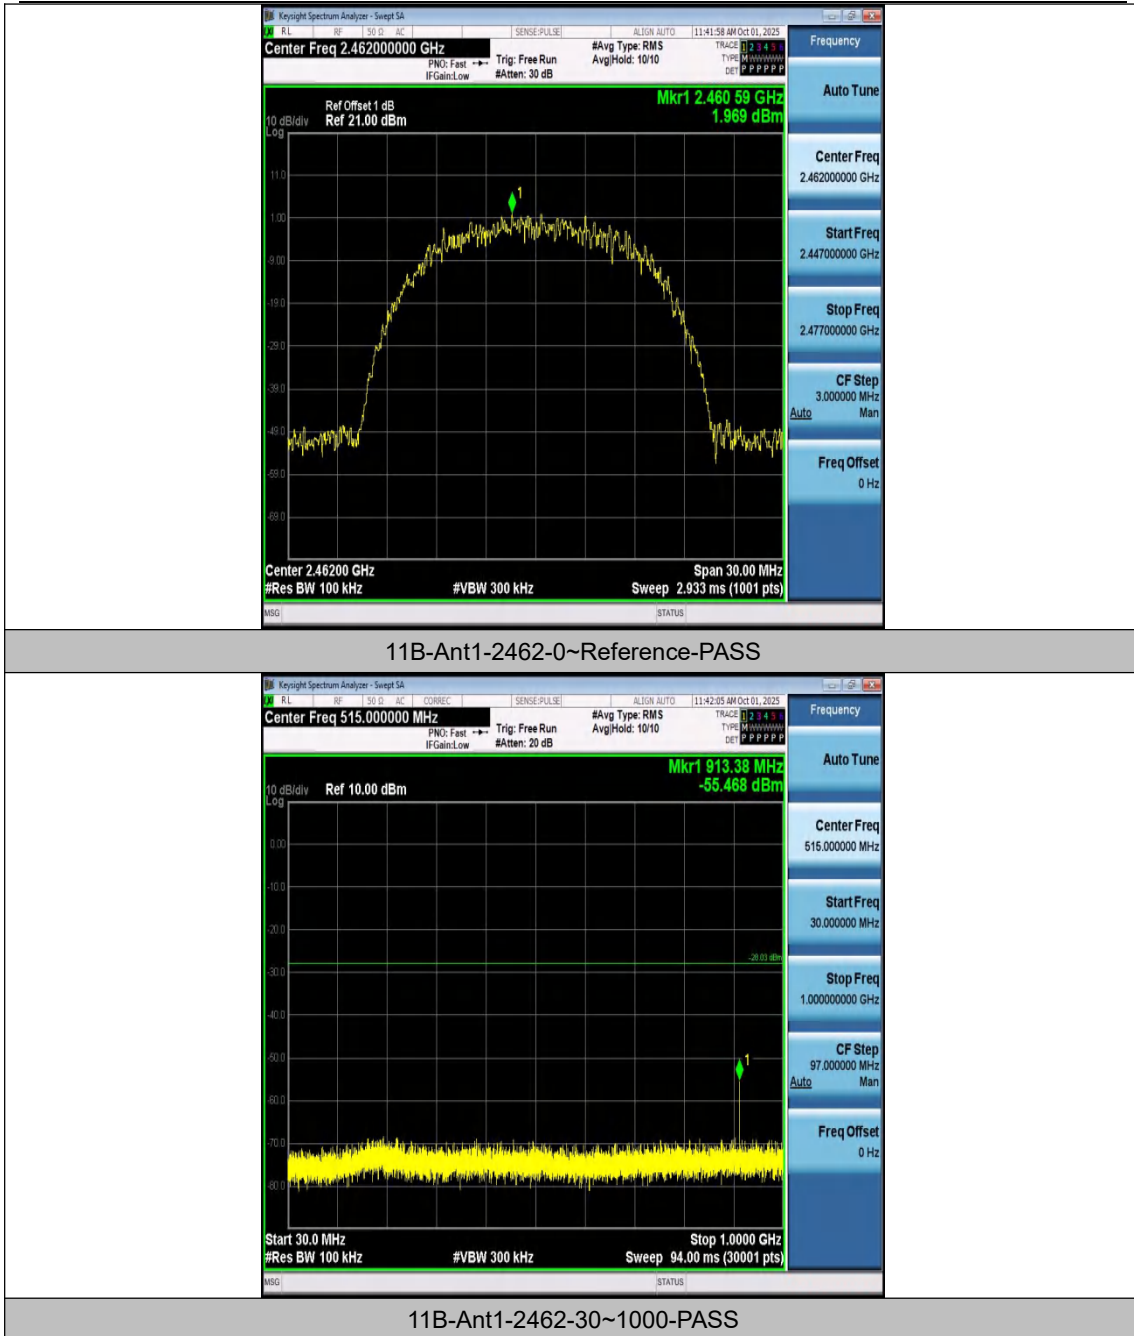

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

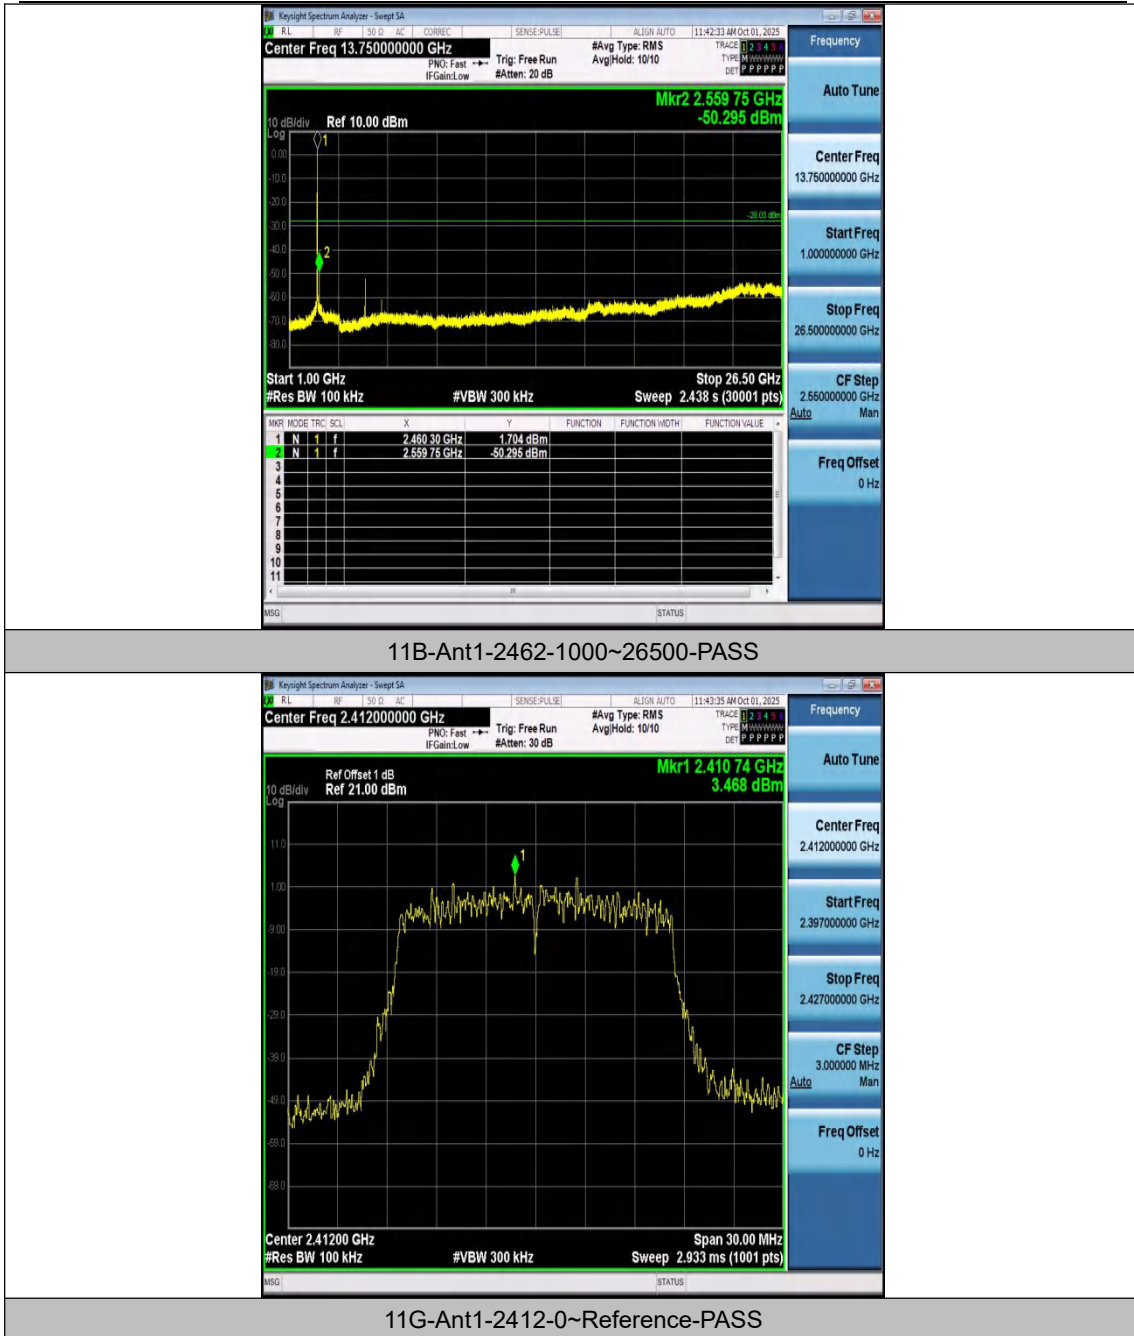

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

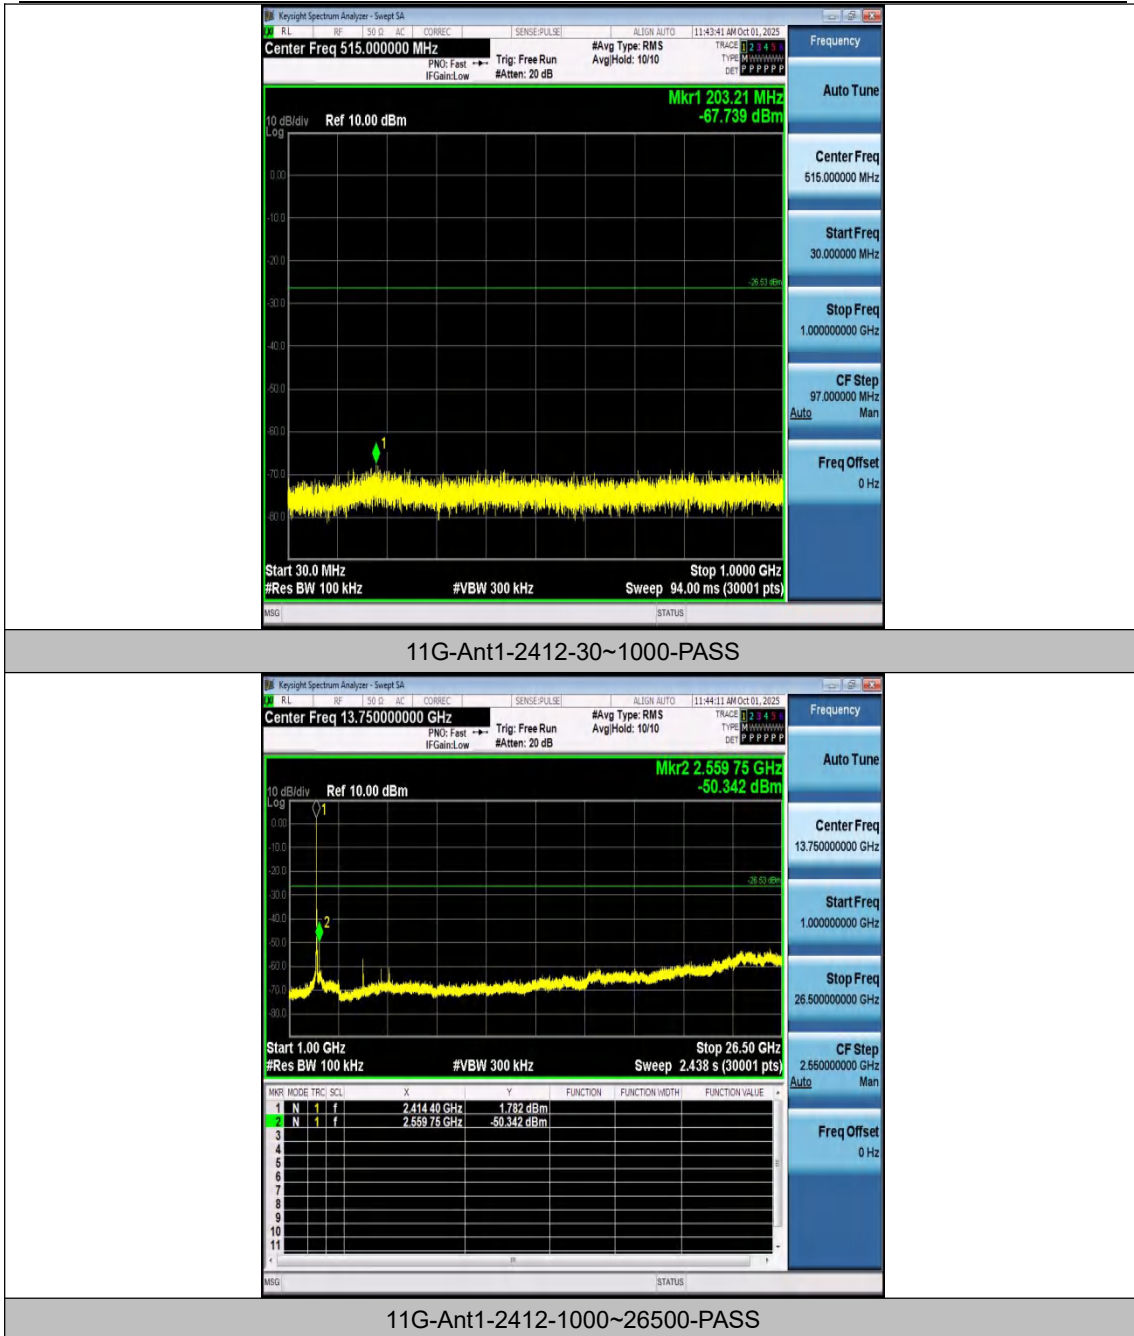

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

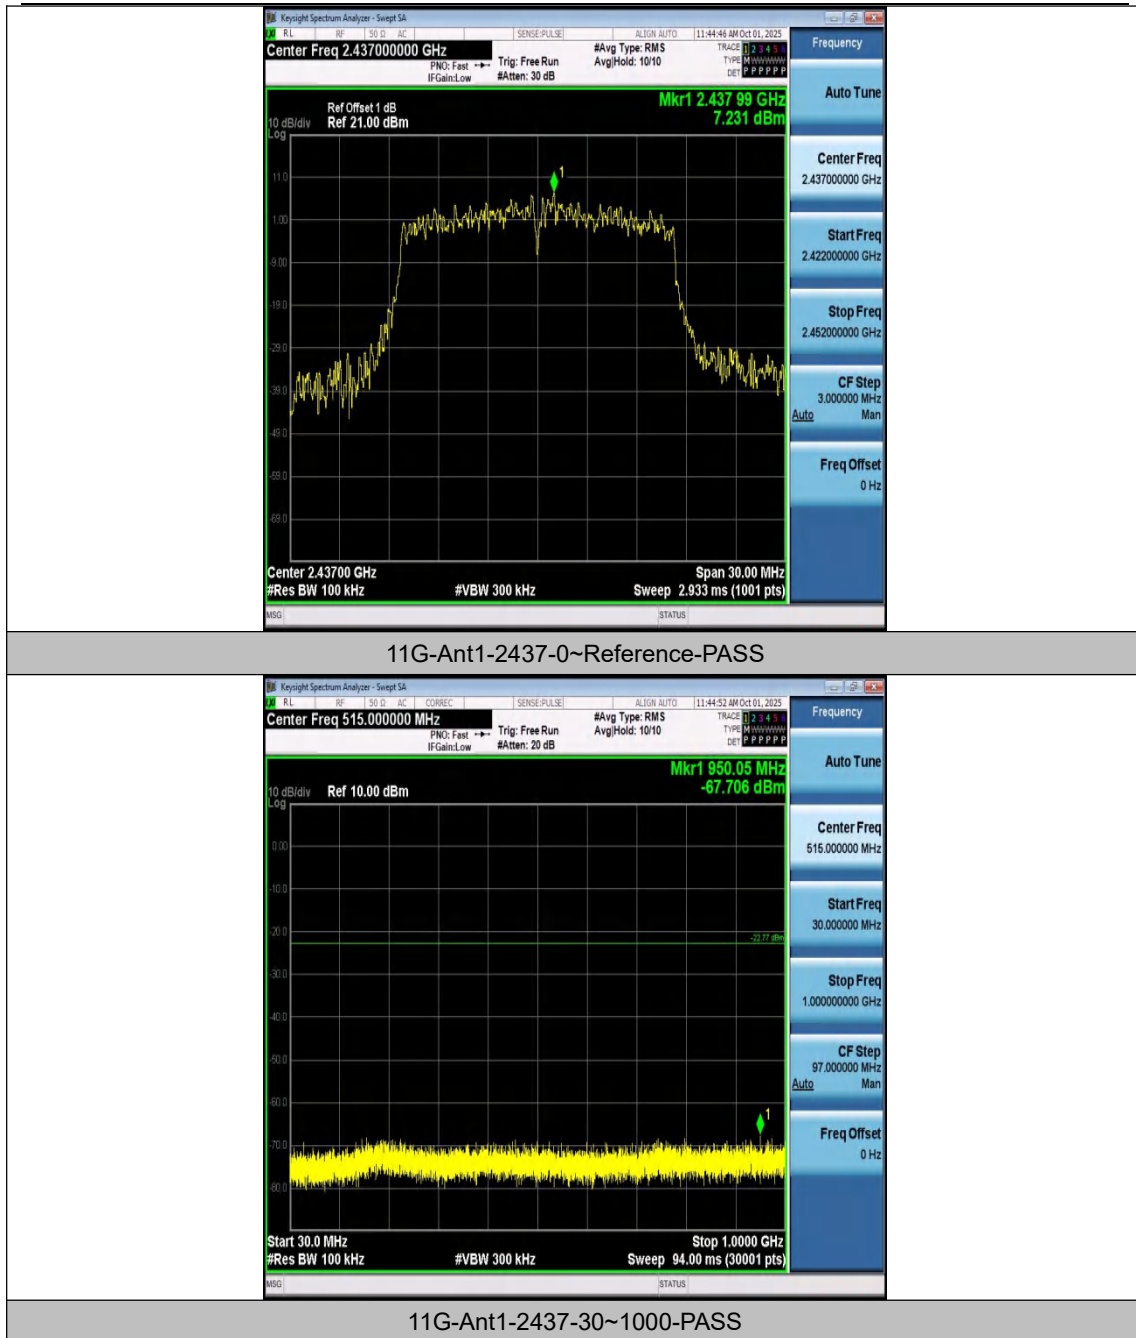

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

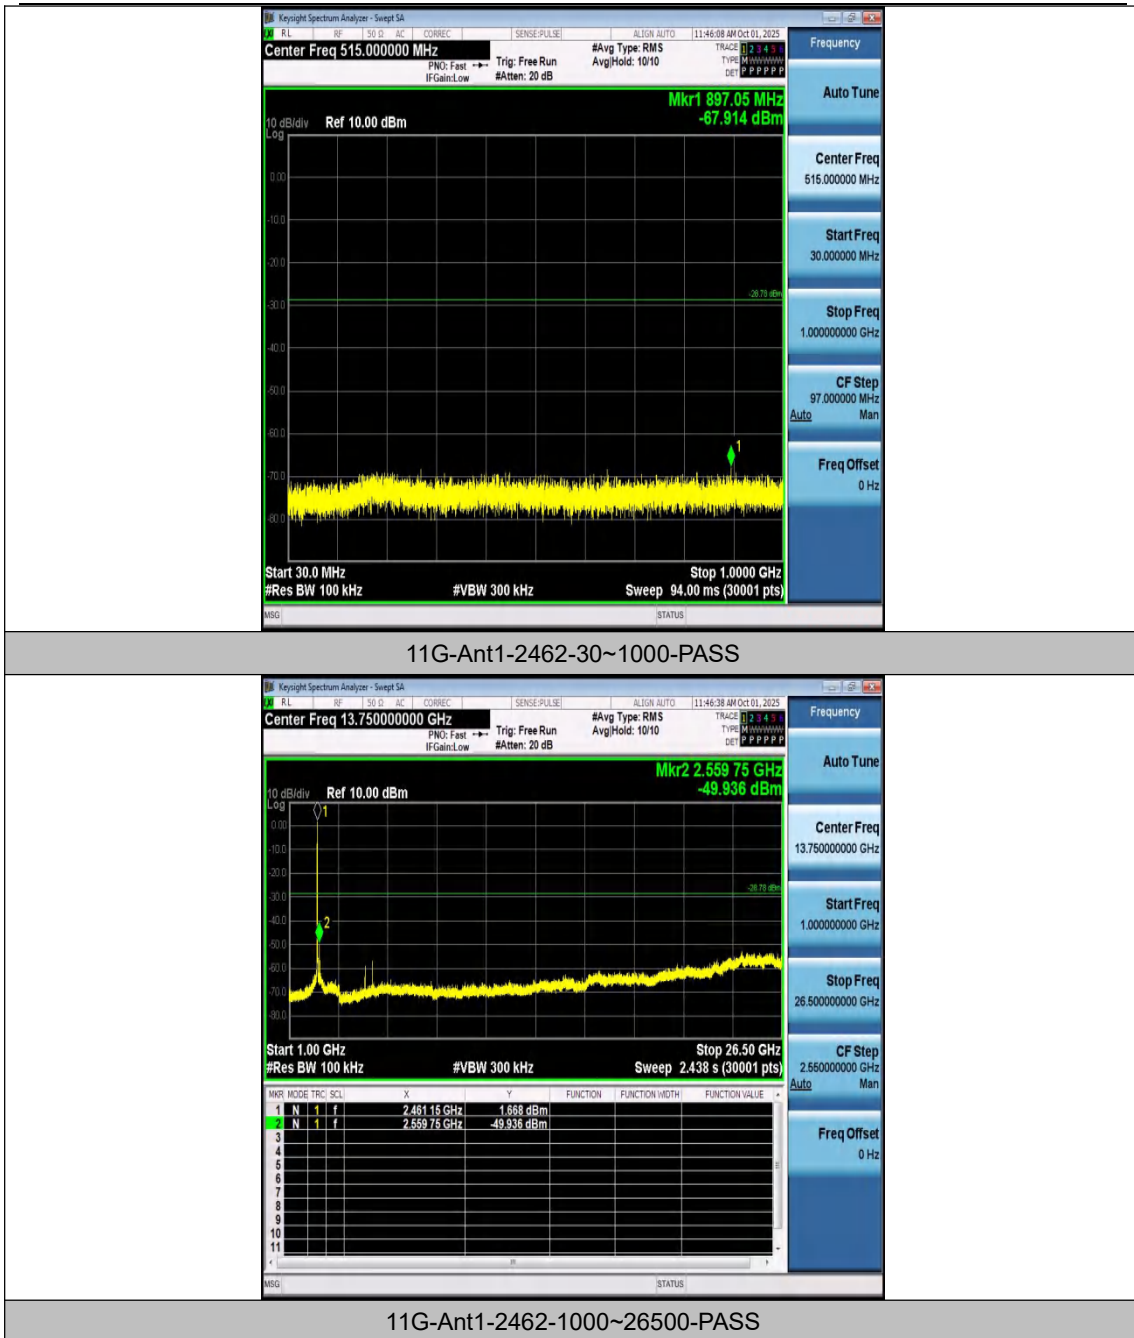

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

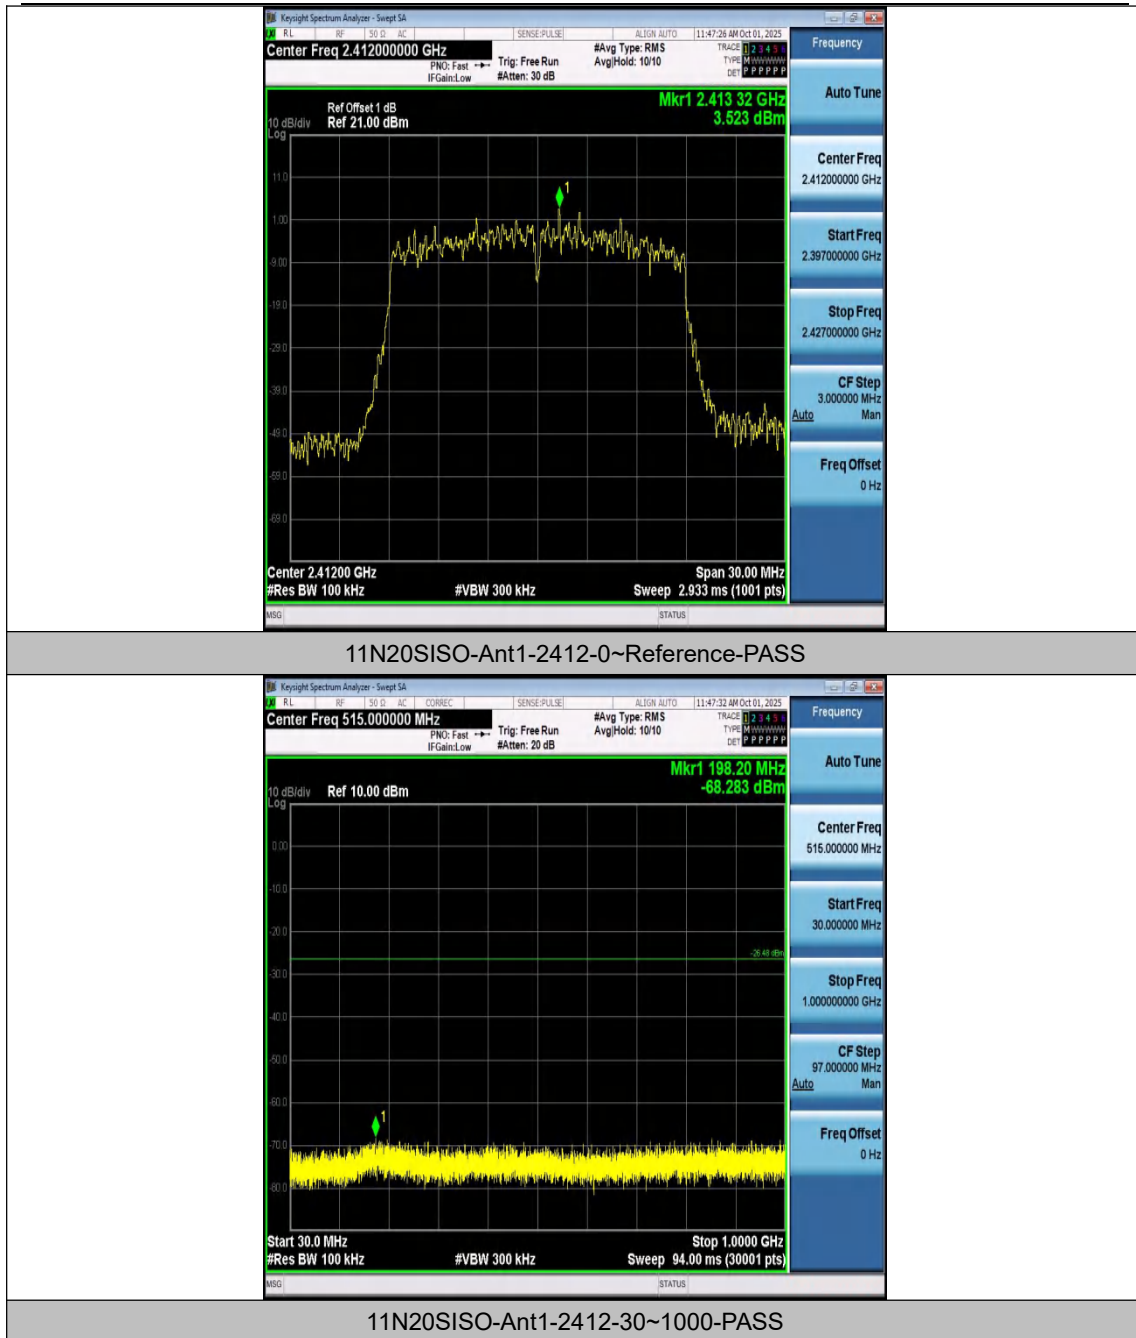

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

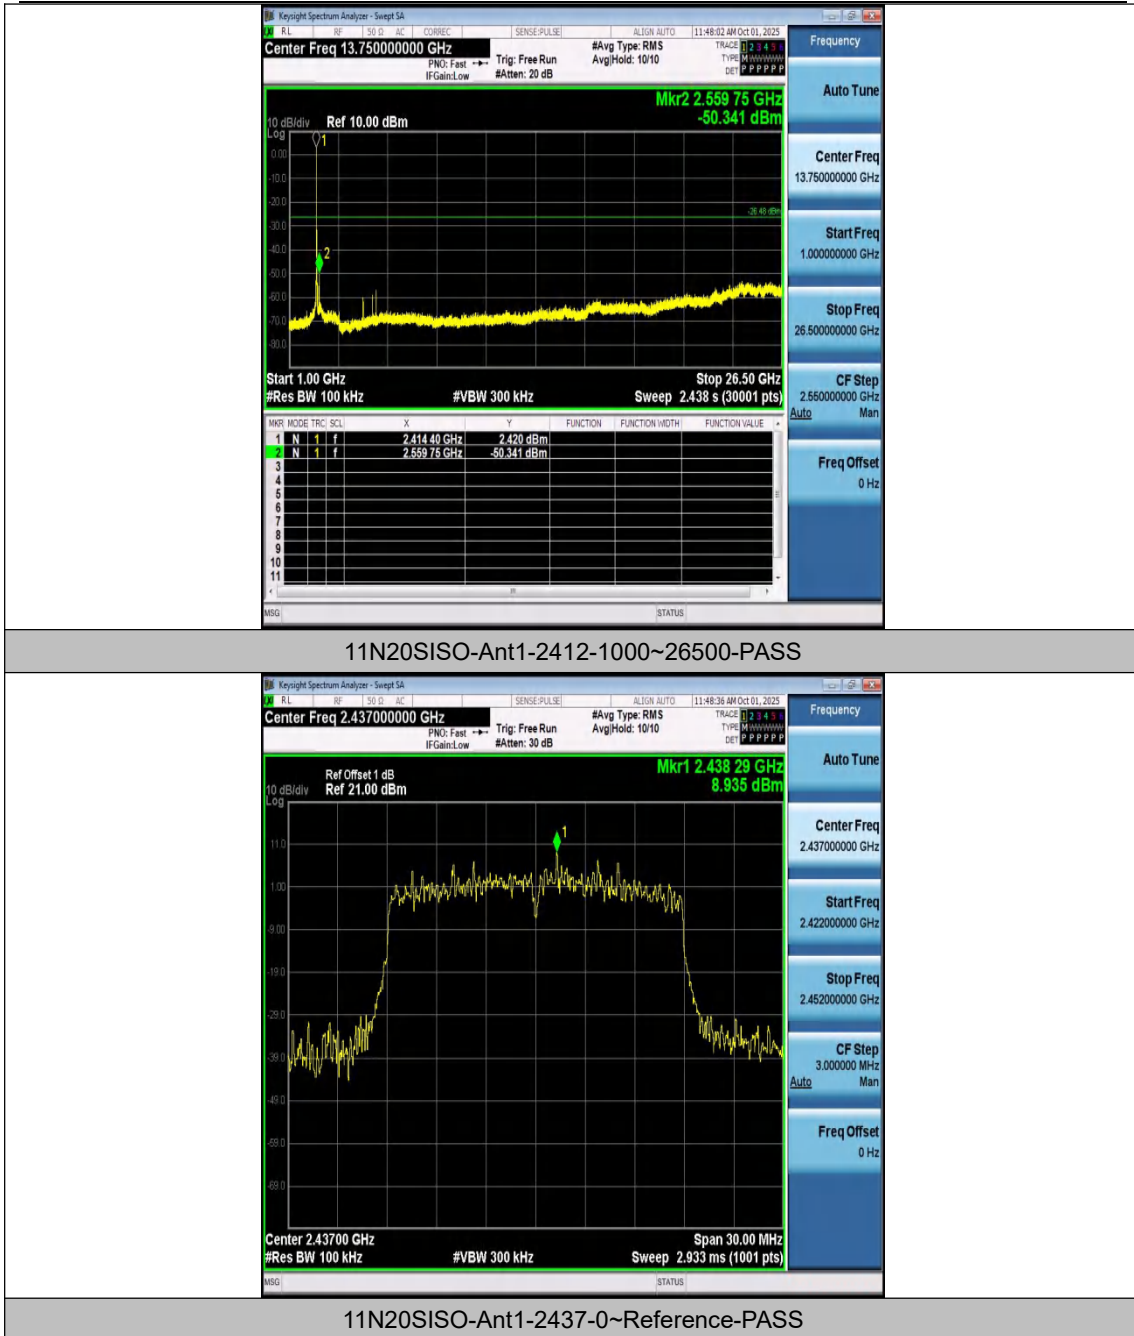

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

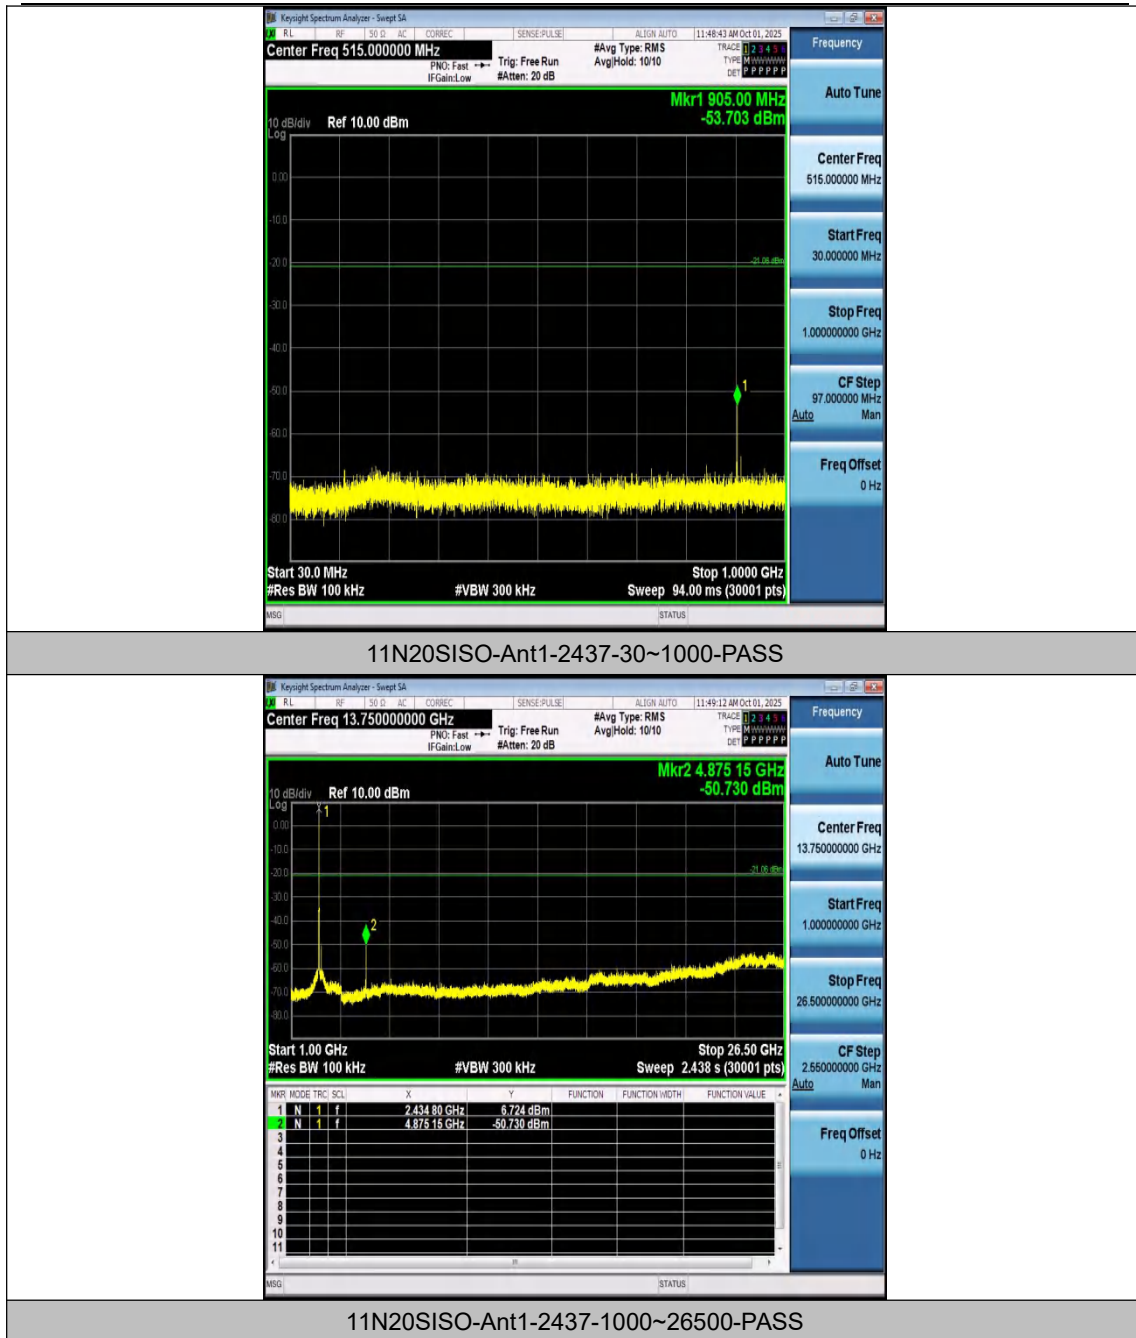

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

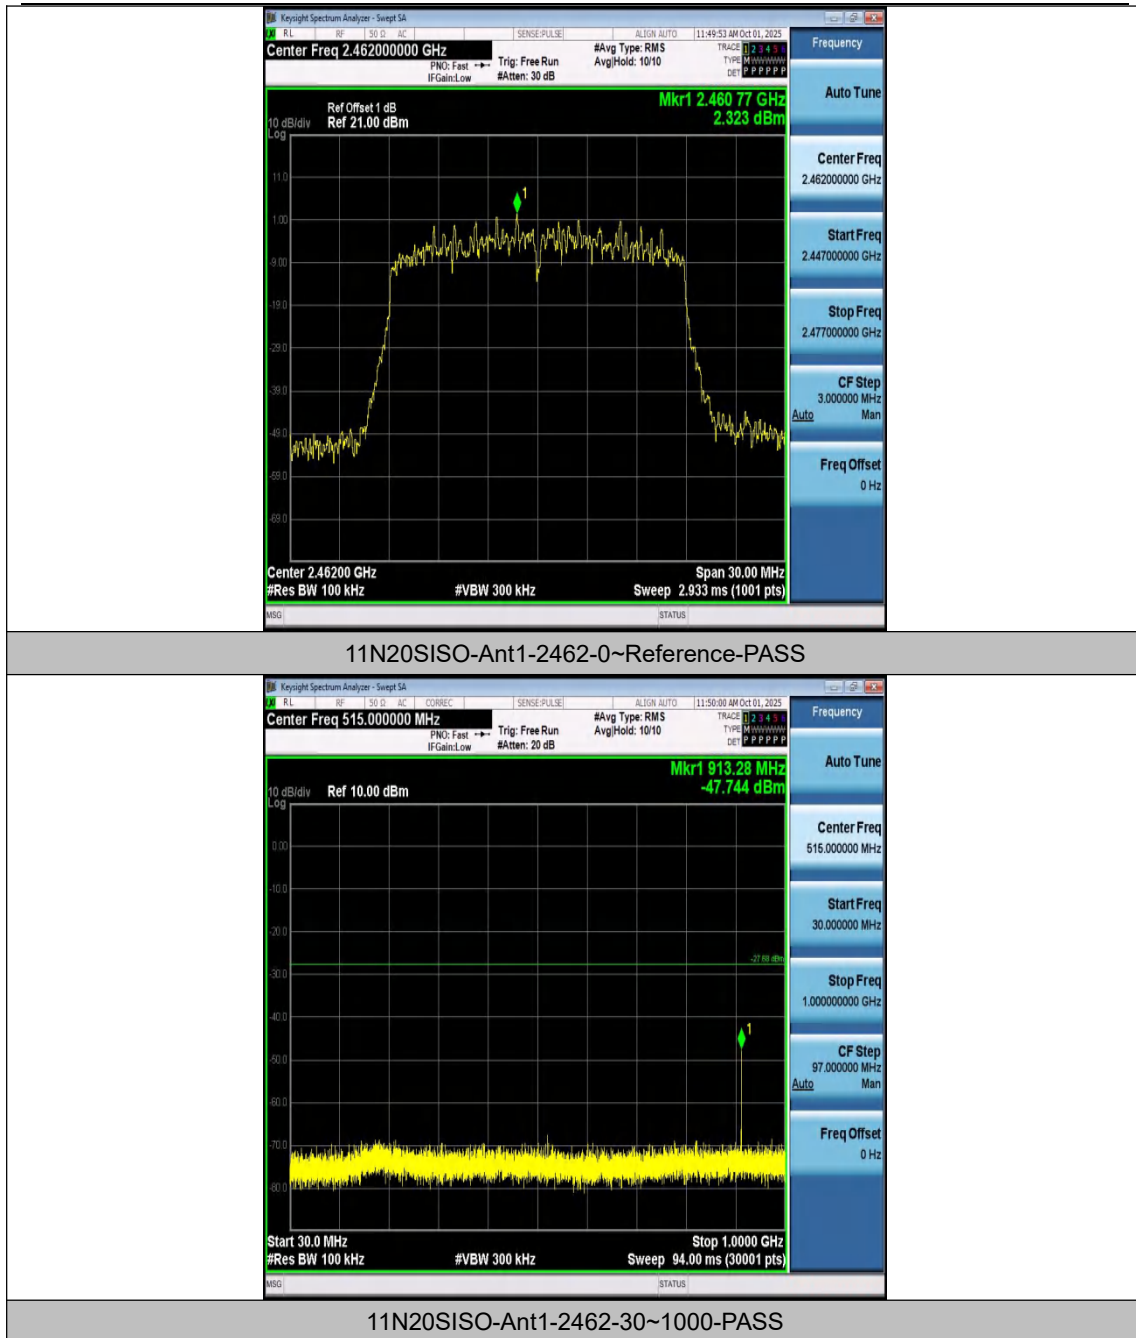

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

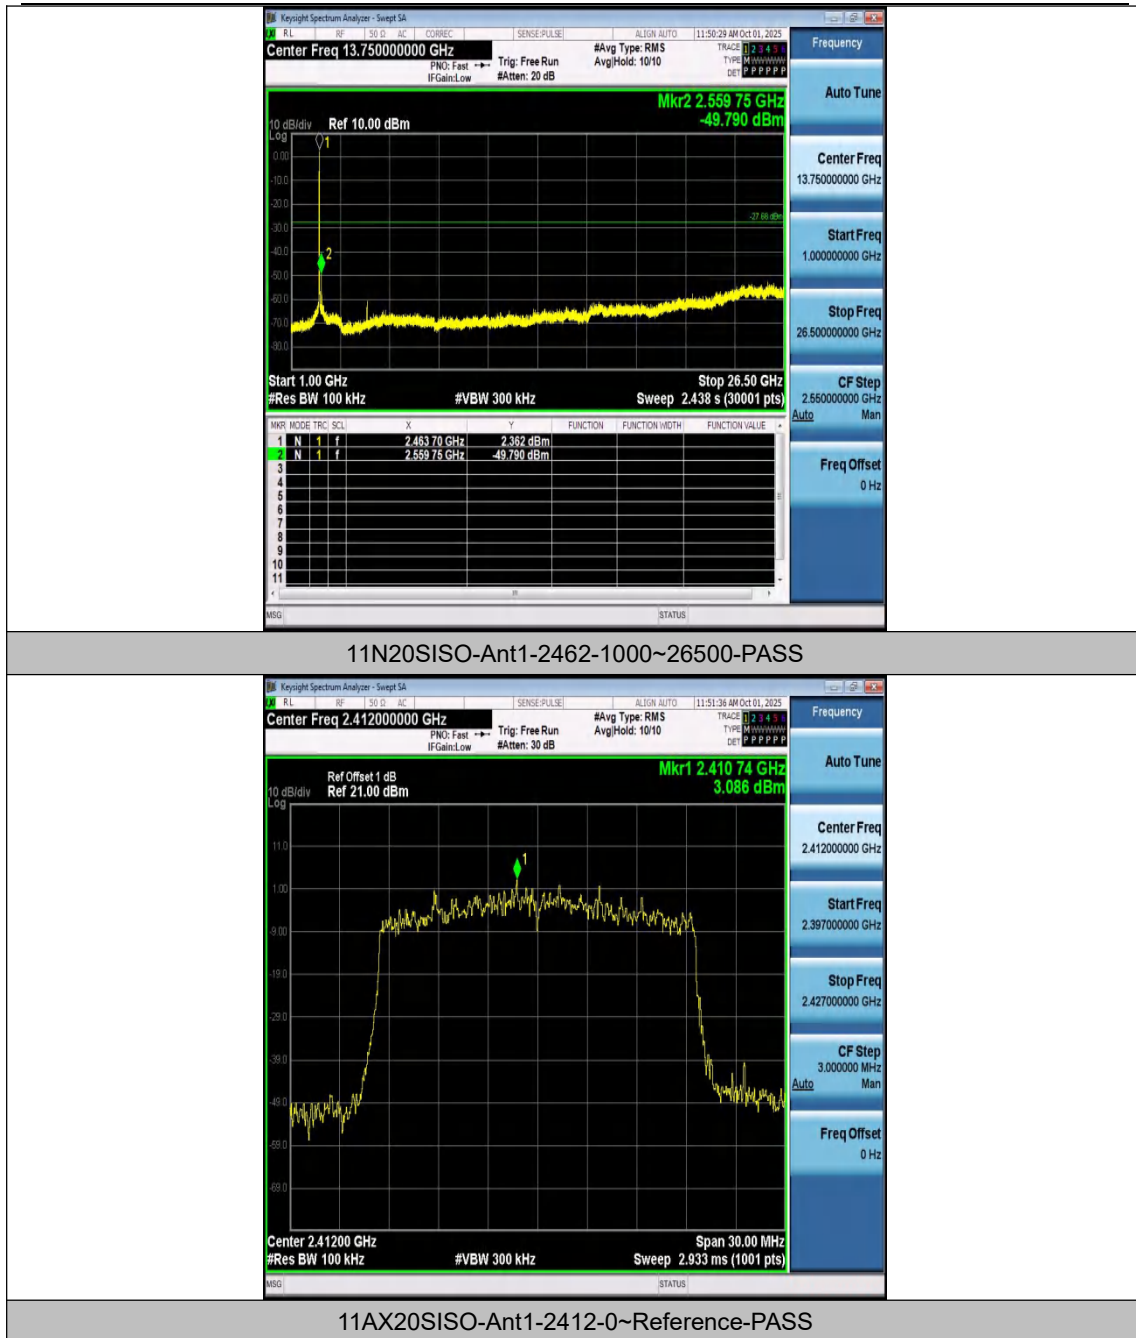

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

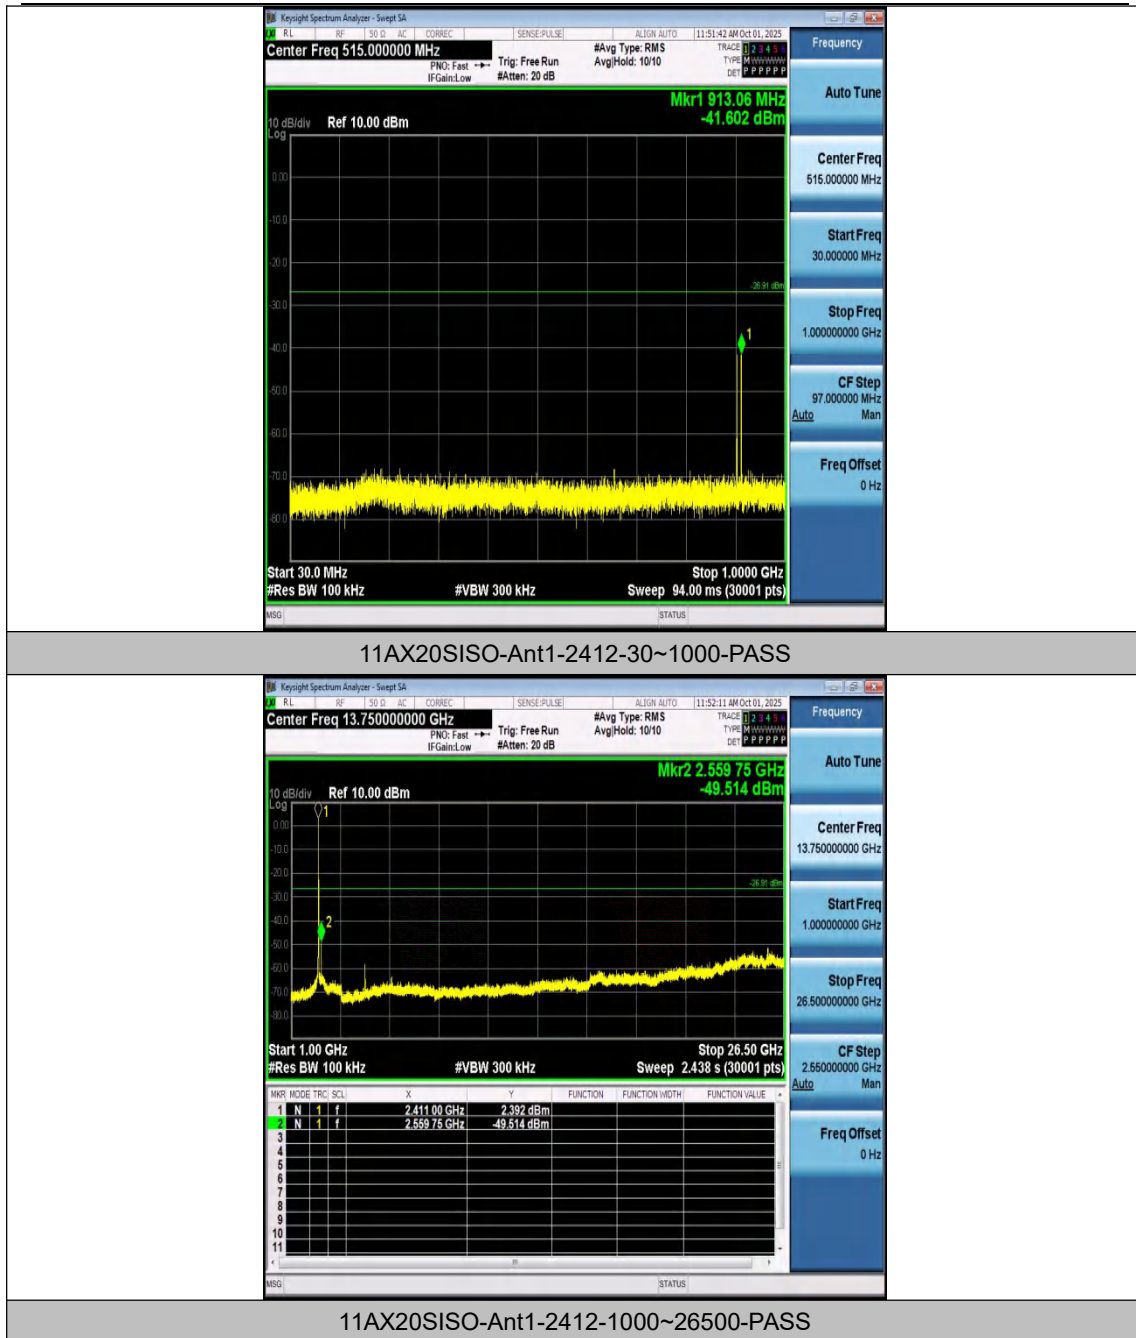

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

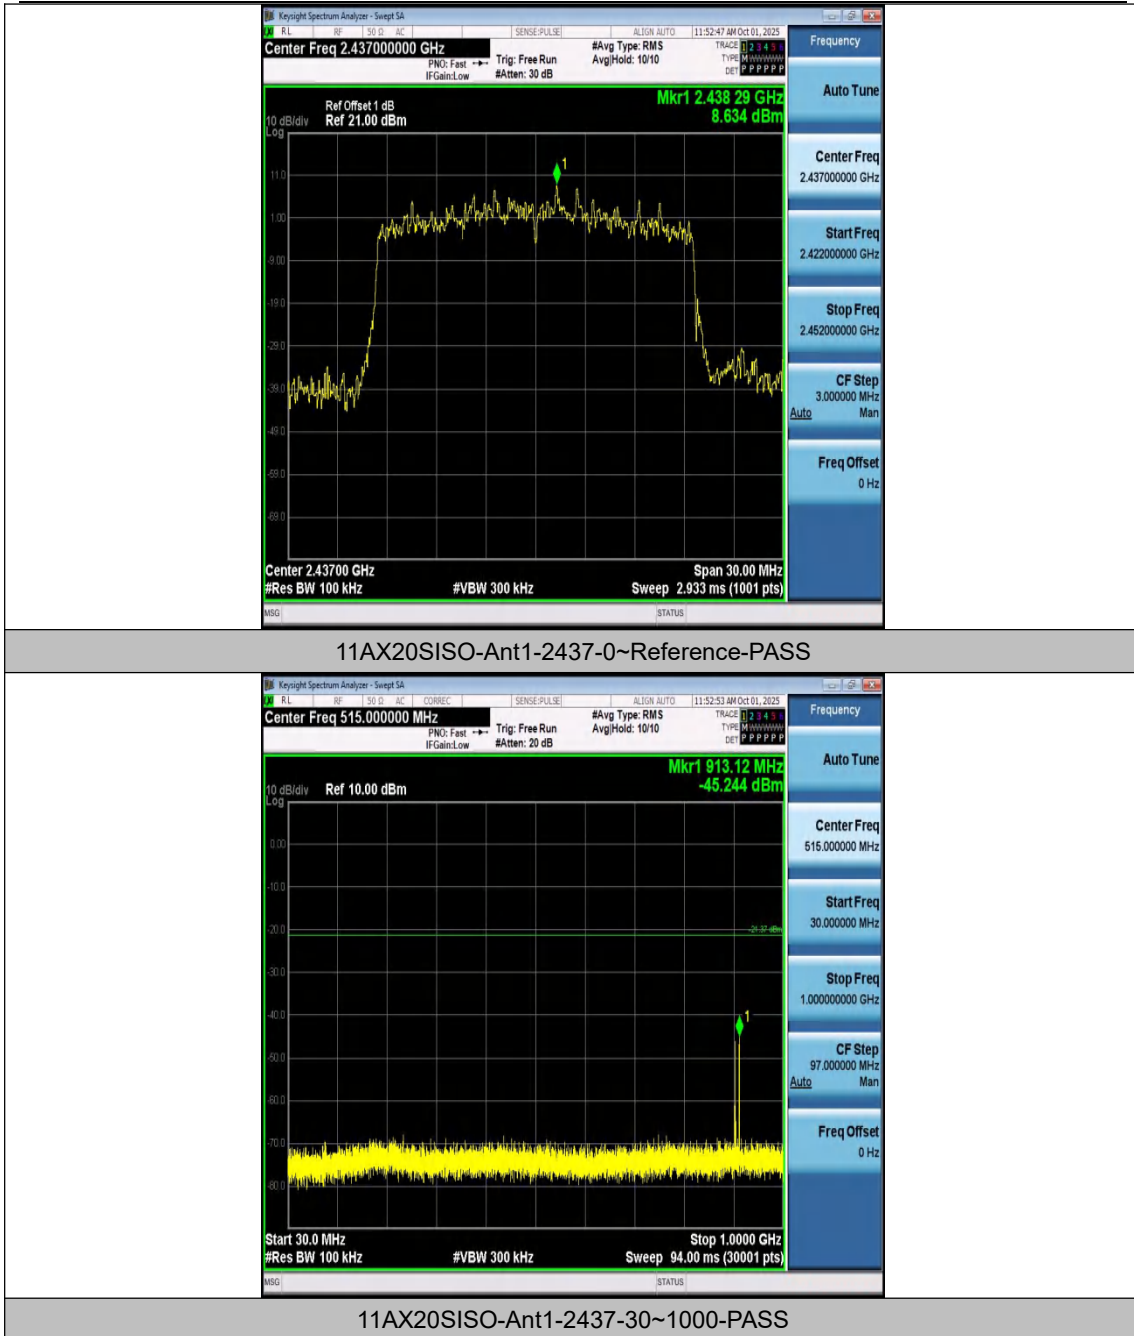

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

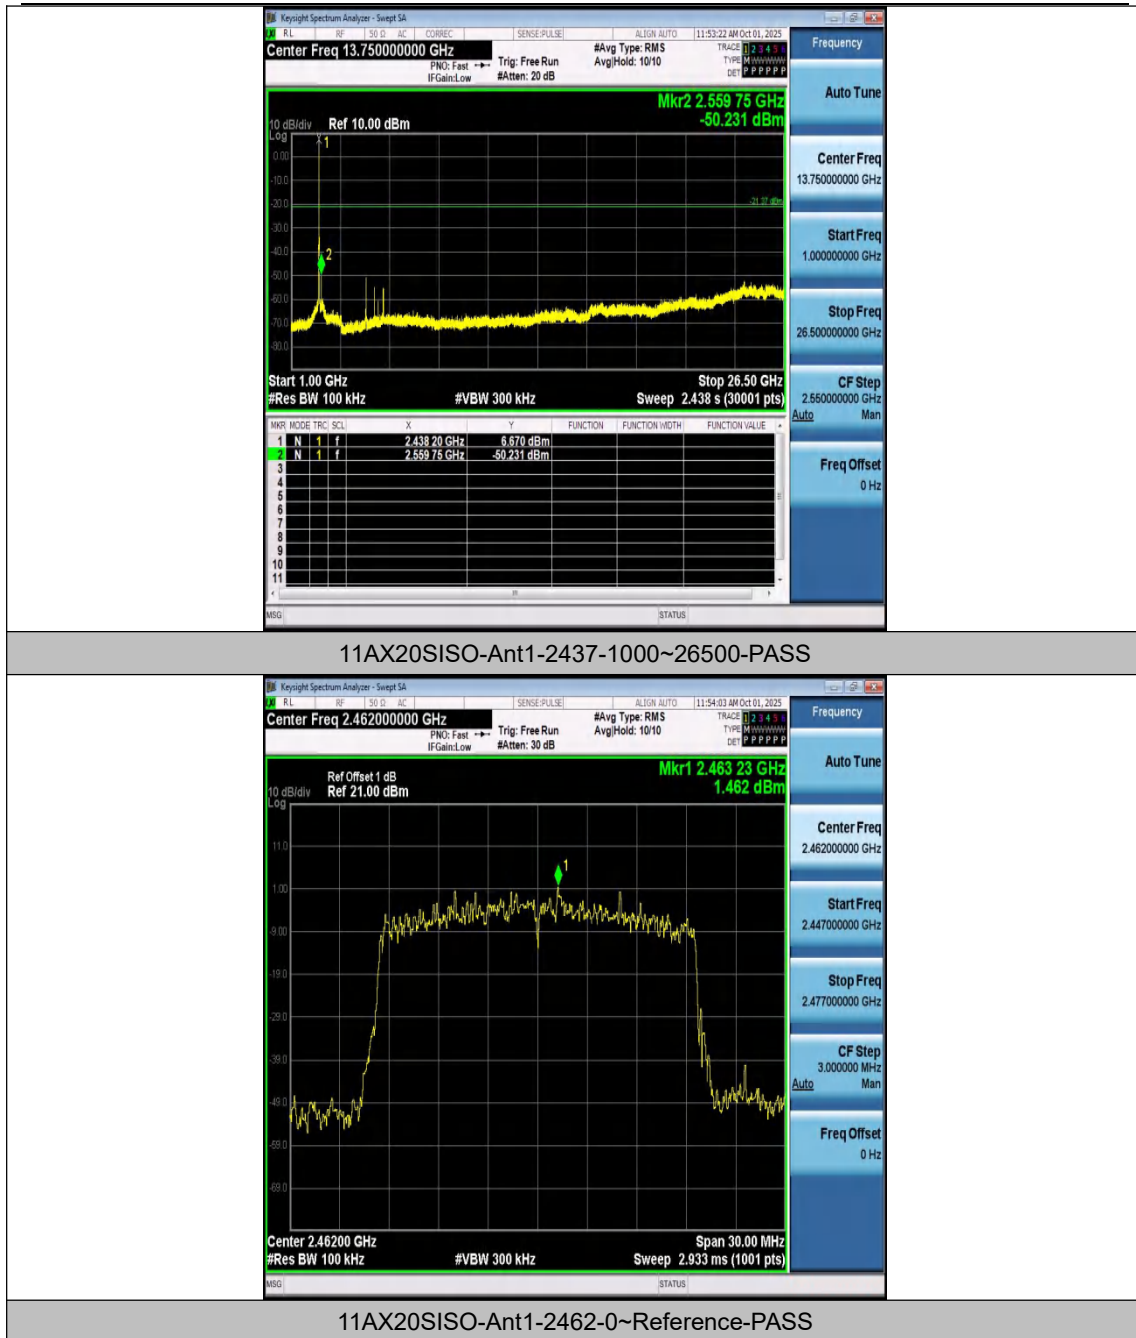

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

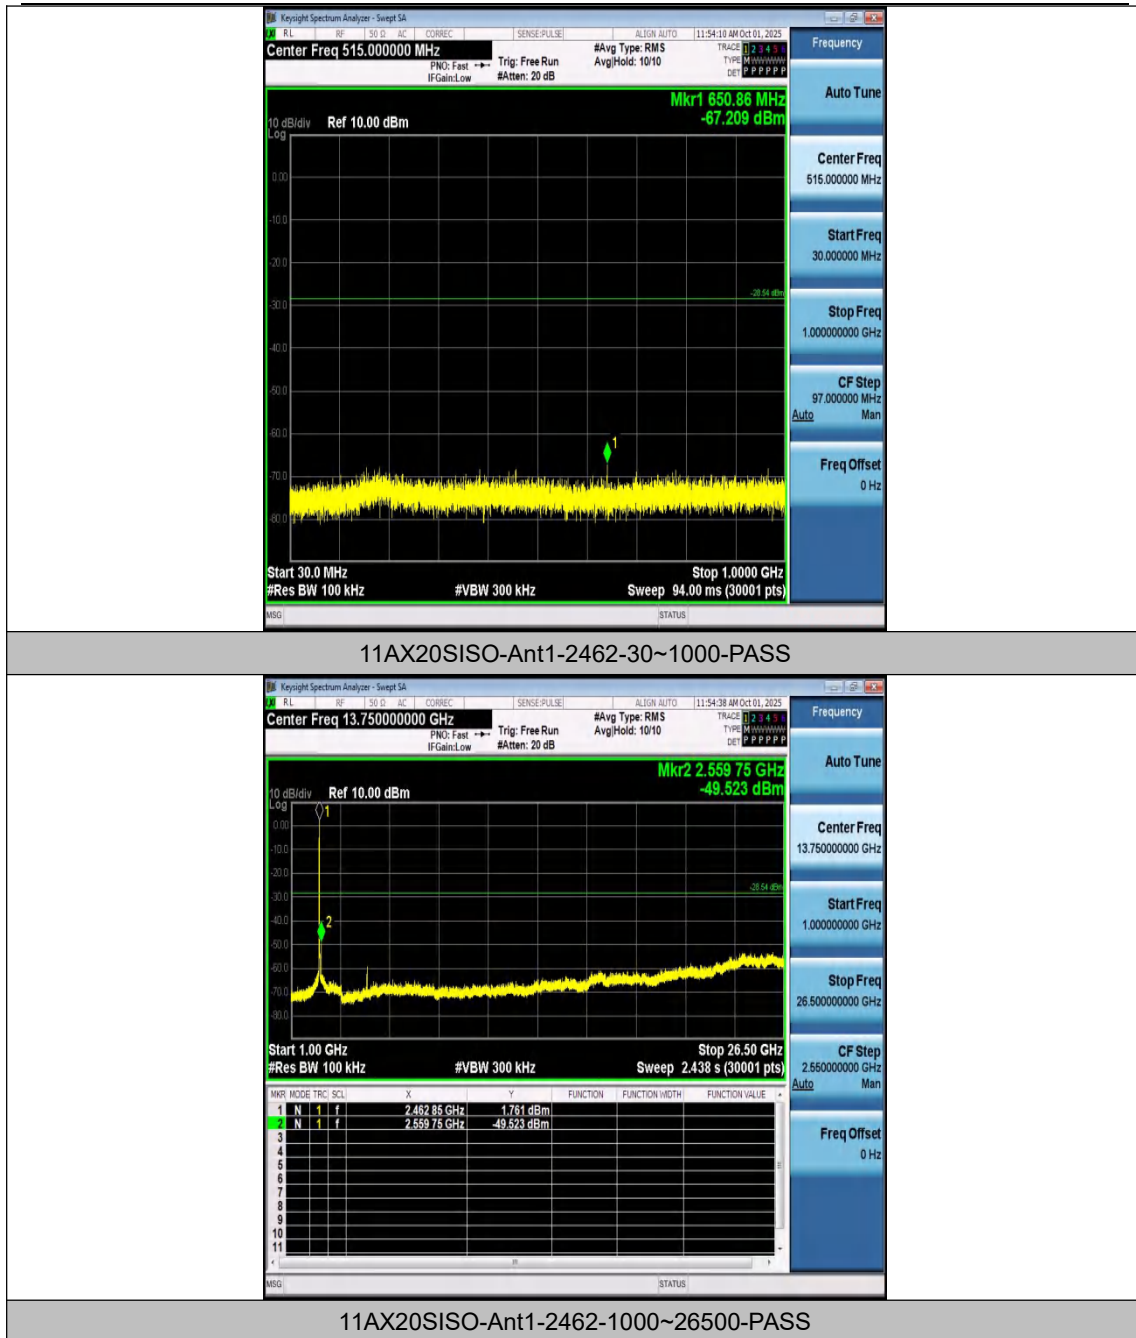

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix G: Duty Cycle

Test Result

Test Mode	Antenna	Frequency [MHz]	Transmission Duration [ms]	Transmission Period [ms]	Duty Cycle [%]	Factor
11B	Ant1	2412	100.00	100.00	100.00	0.00
11B	Ant1	2437	100.00	100.00	100.00	0.00
11B	Ant1	2462	100.00	100.00	100.00	0.00
11G	Ant1	2412	100.00	100.00	100.00	0.00
11G	Ant1	2437	100.00	100.00	100.00	0.00
11G	Ant1	2462	100.00	100.00	100.00	0.00
11N20SISO	Ant1	2412	100.00	100.00	100.00	0.00
11N20SISO	Ant1	2437	100.00	100.00	100.00	0.00
11N20SISO	Ant1	2462	100.00	100.00	100.00	0.00
11AX20SISO	Ant1	2412	100.00	100.00	100.00	0.00
11AX20SISO	Ant1	2437	100.00	100.00	100.00	0.00
11AX20SISO	Ant1	2462	100.00	100.00	100.00	0.00


Test Graphs

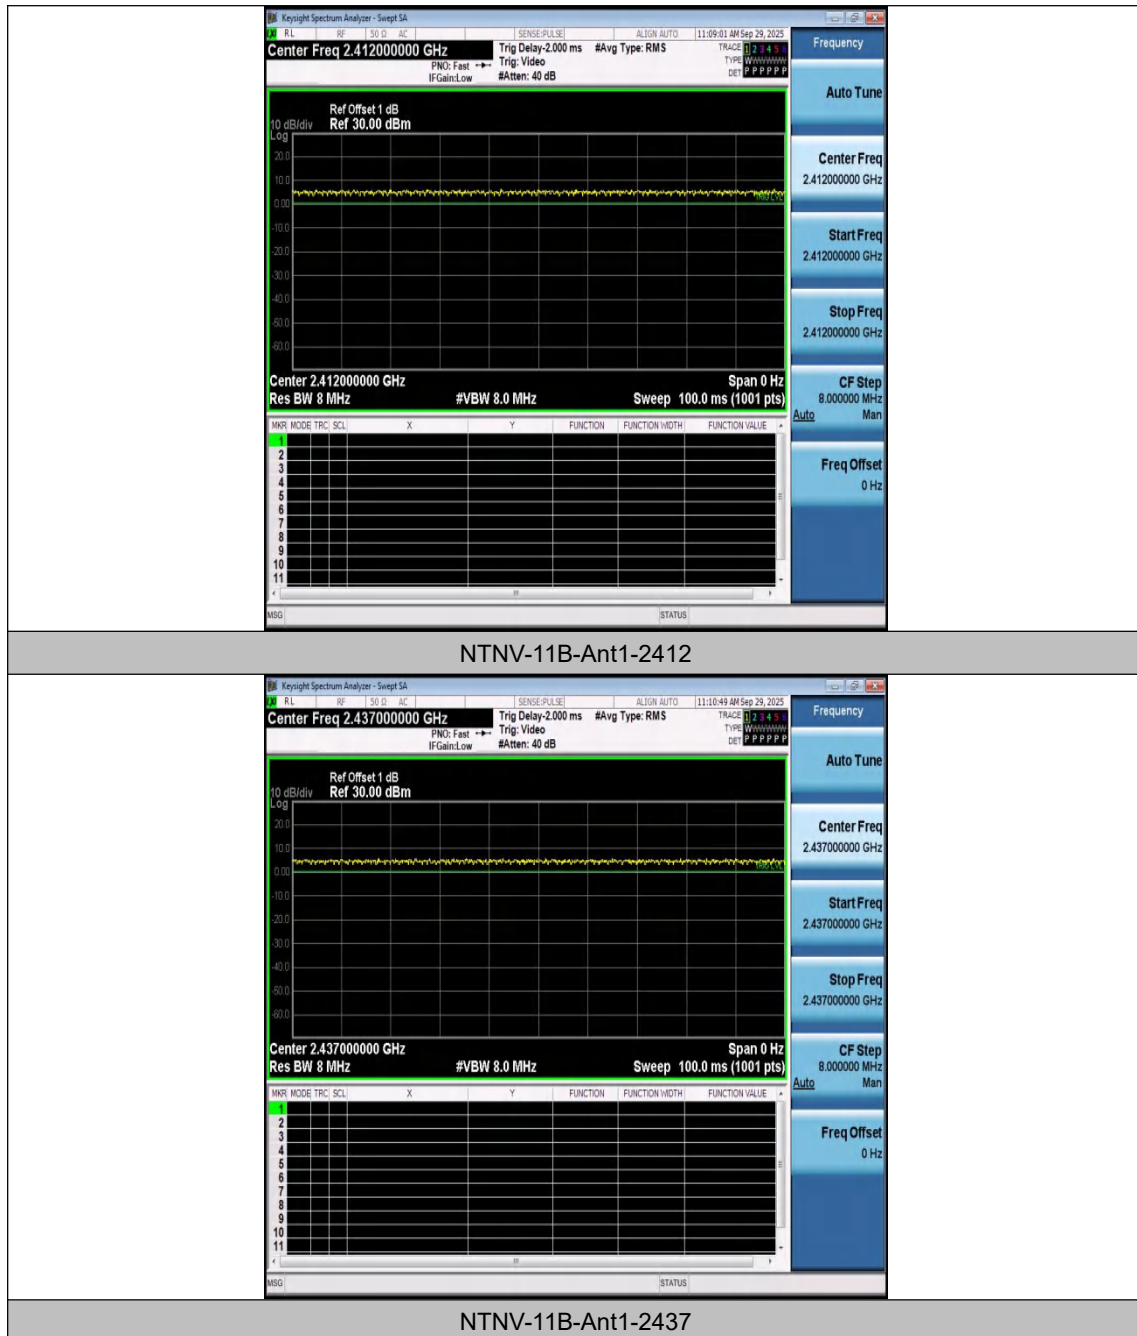

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

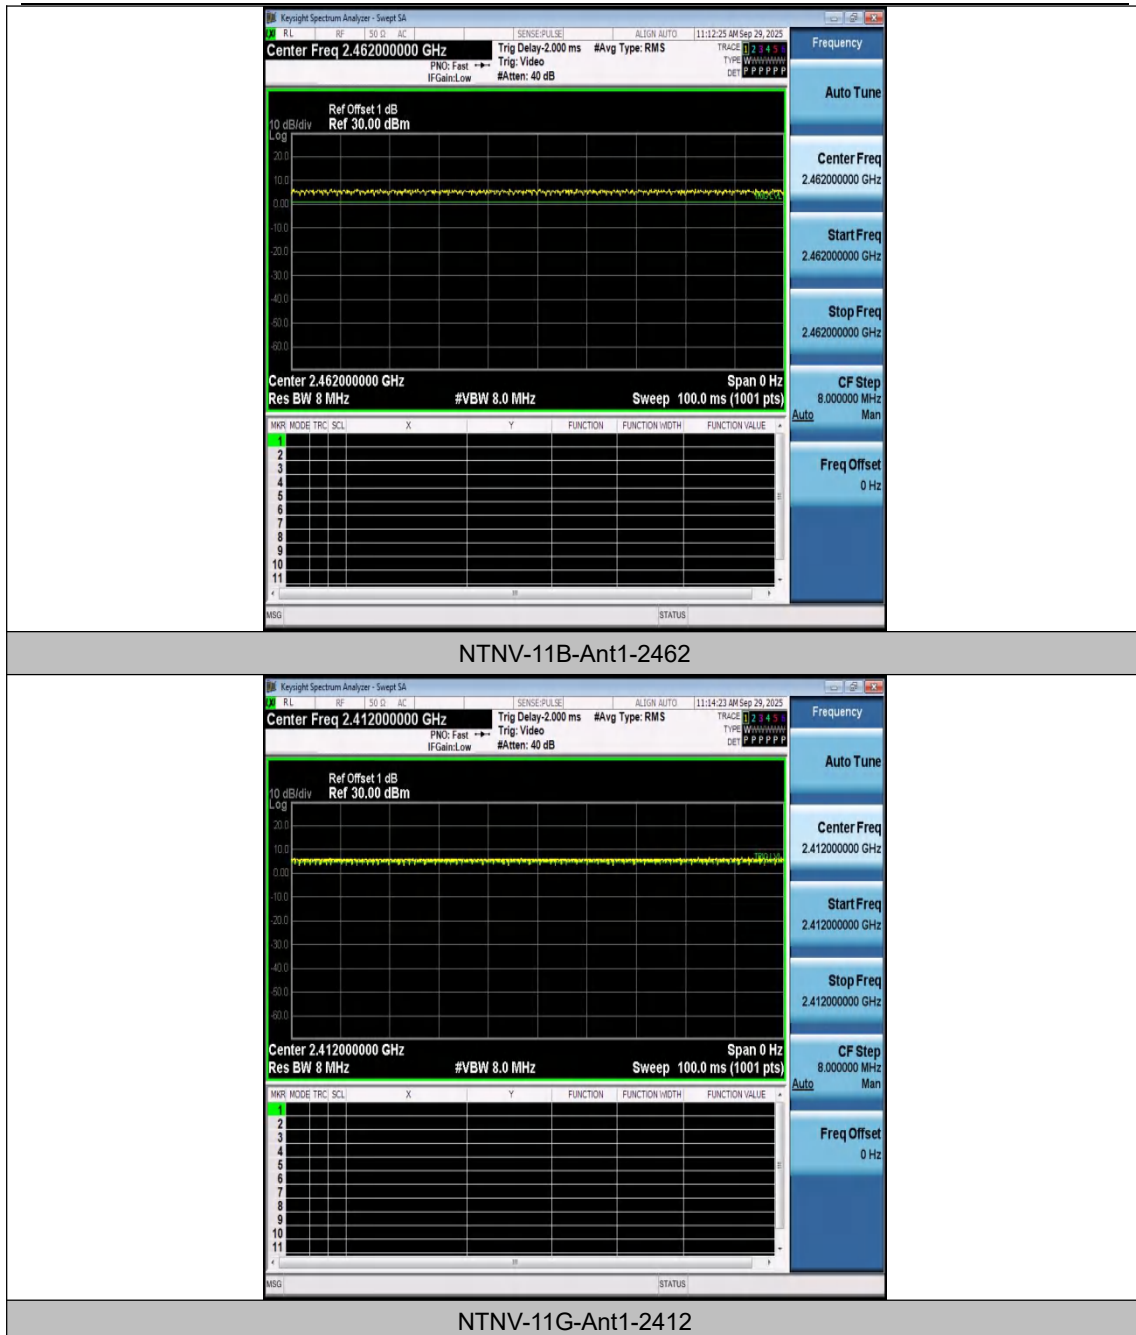

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

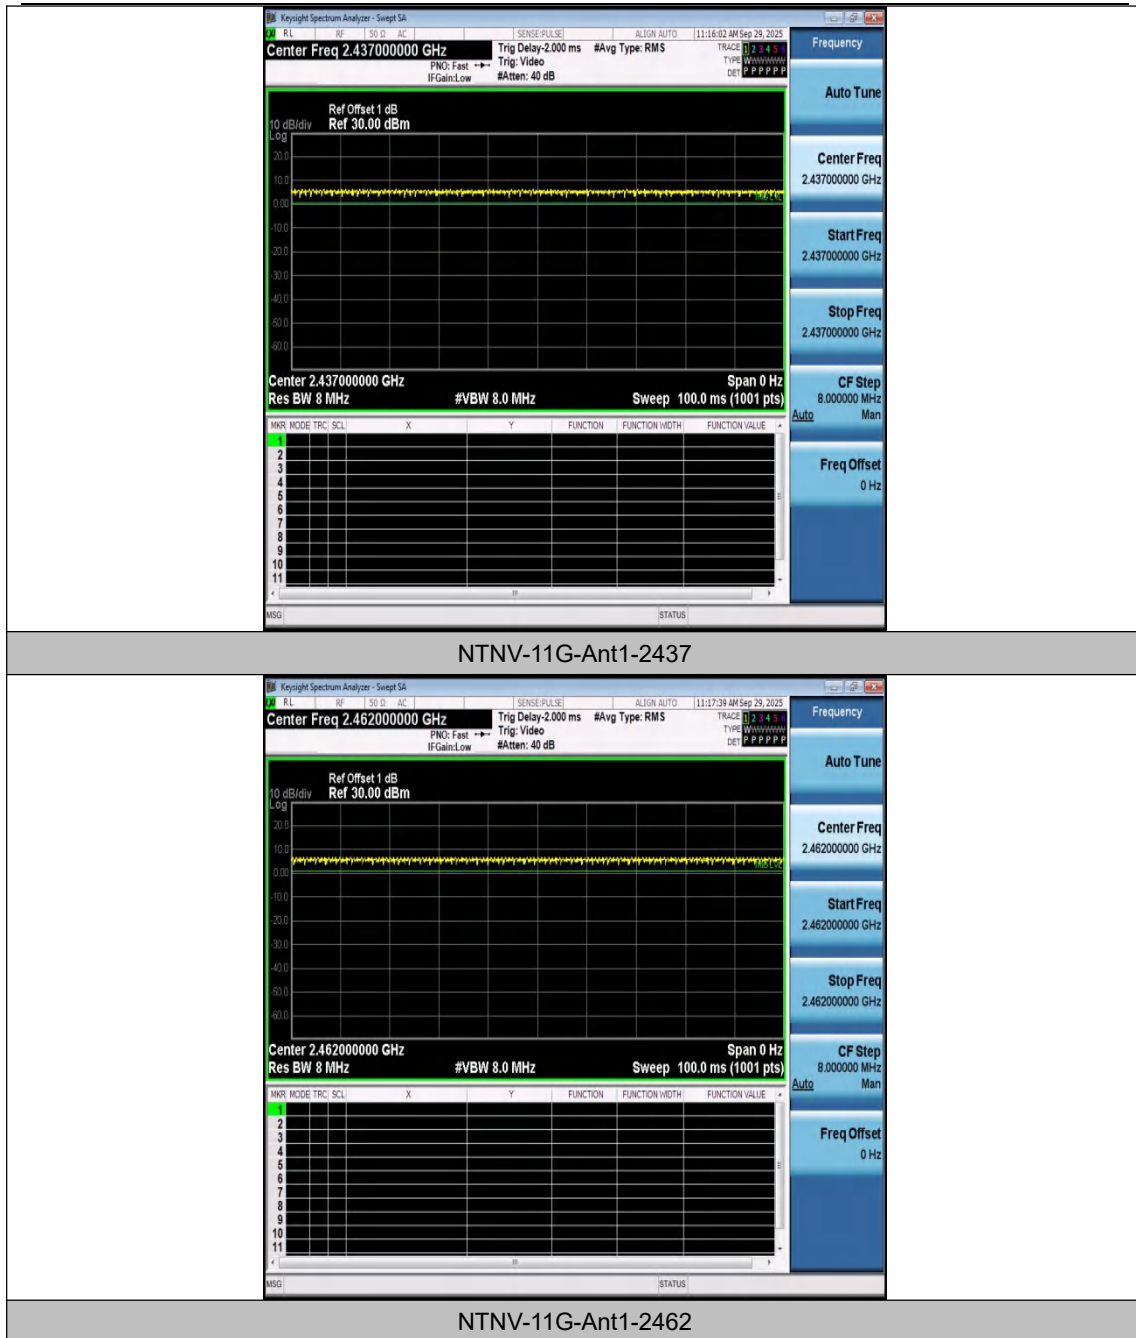

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

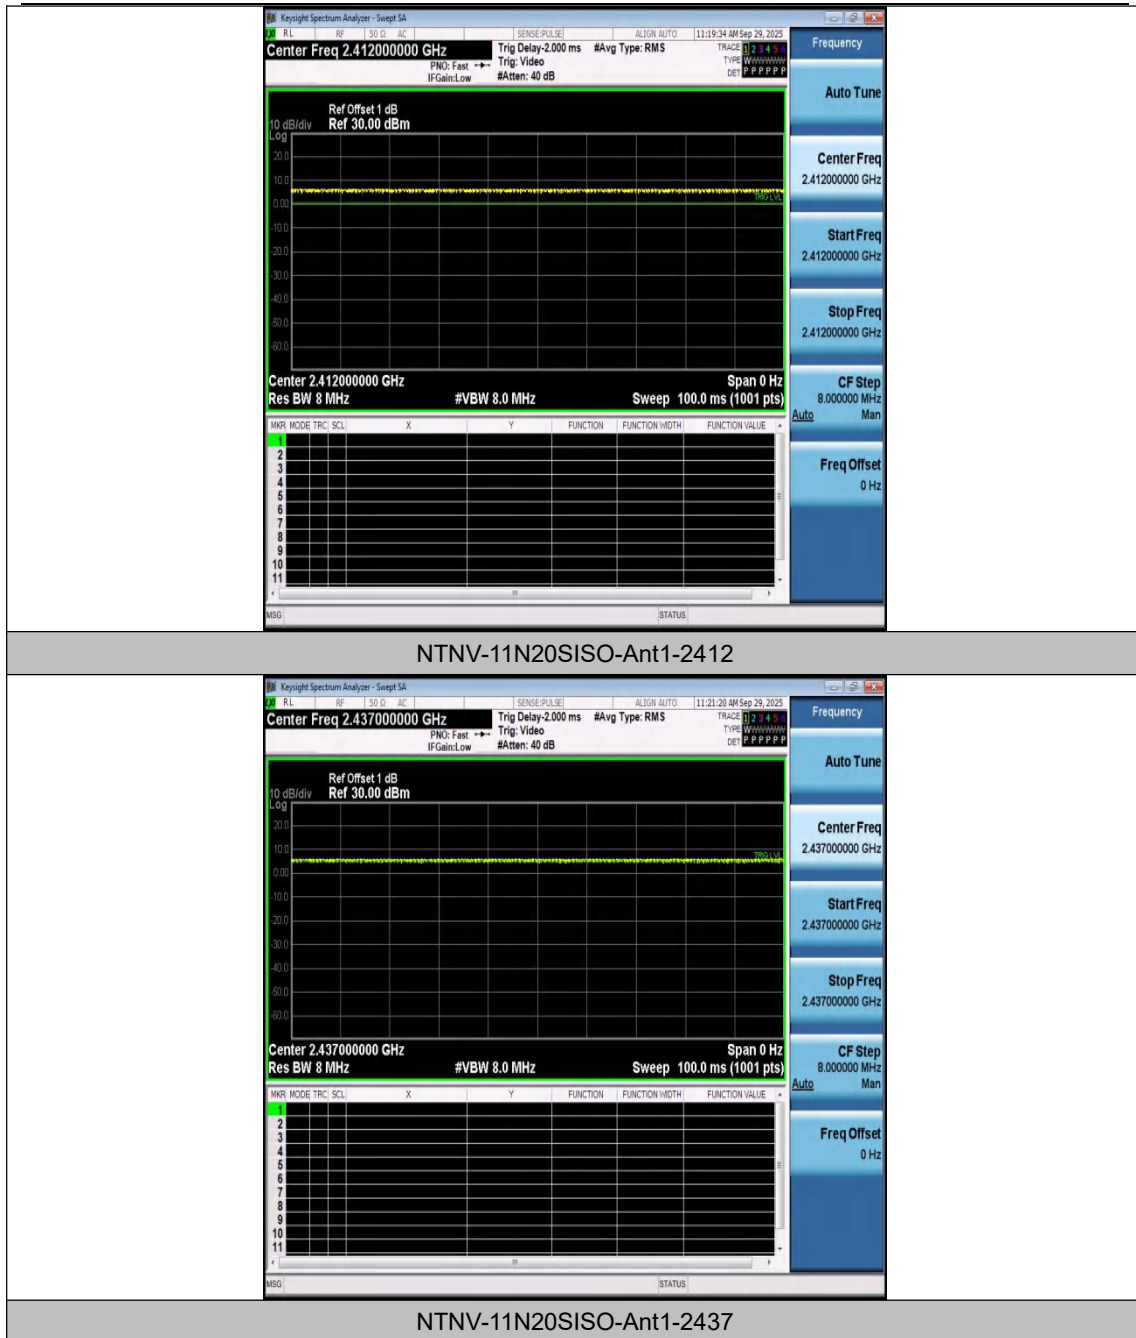

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

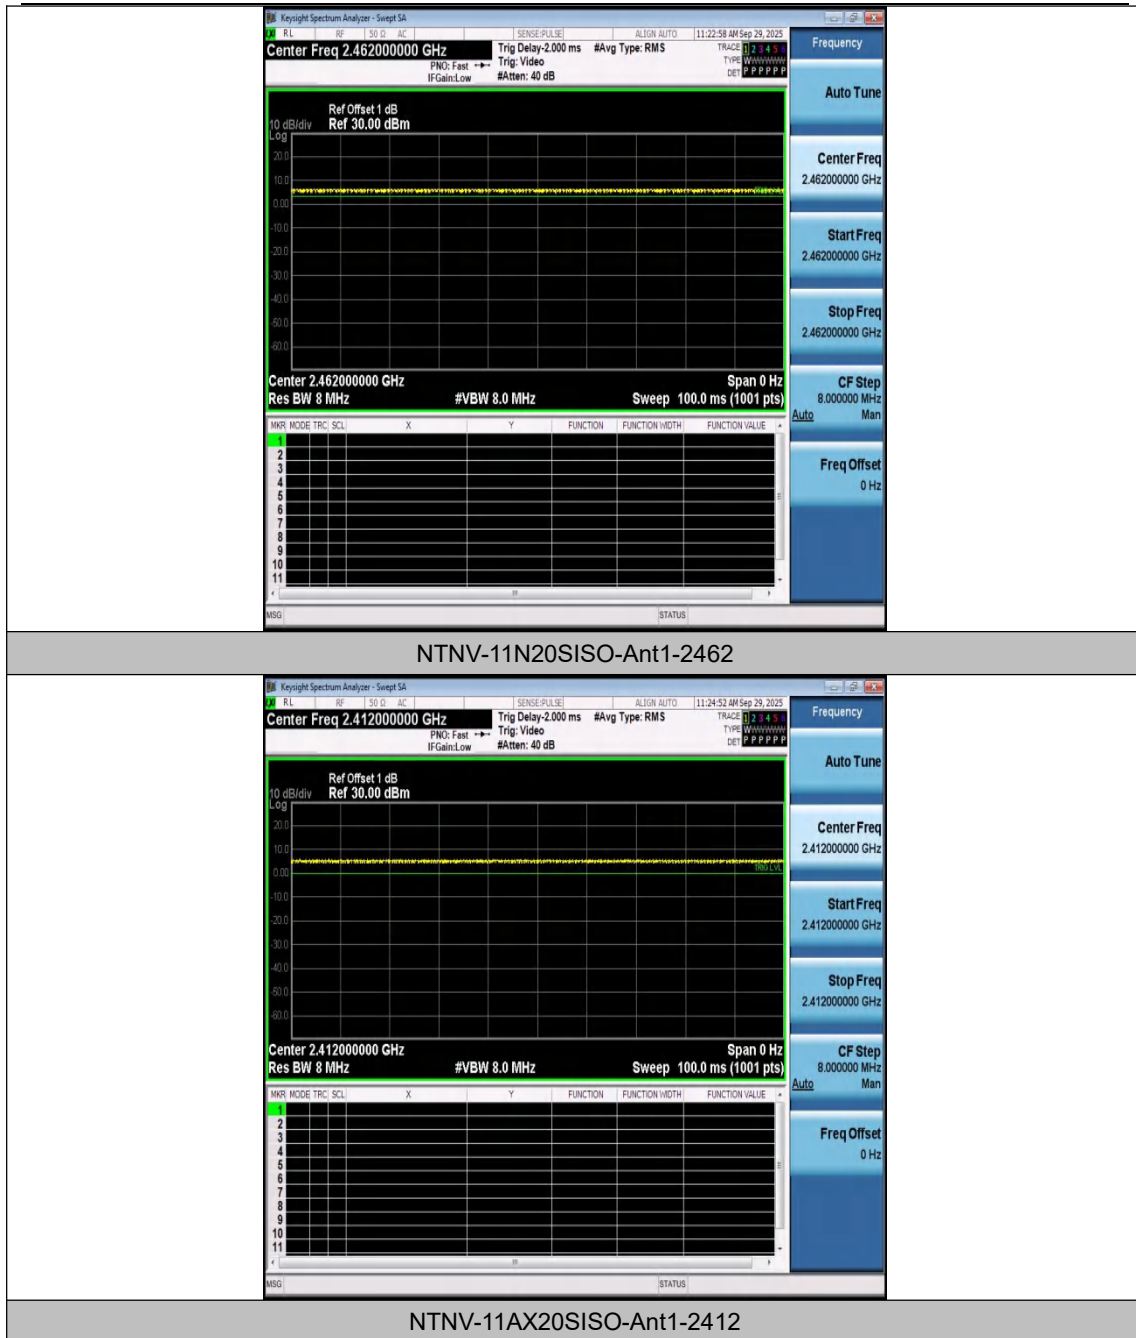

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

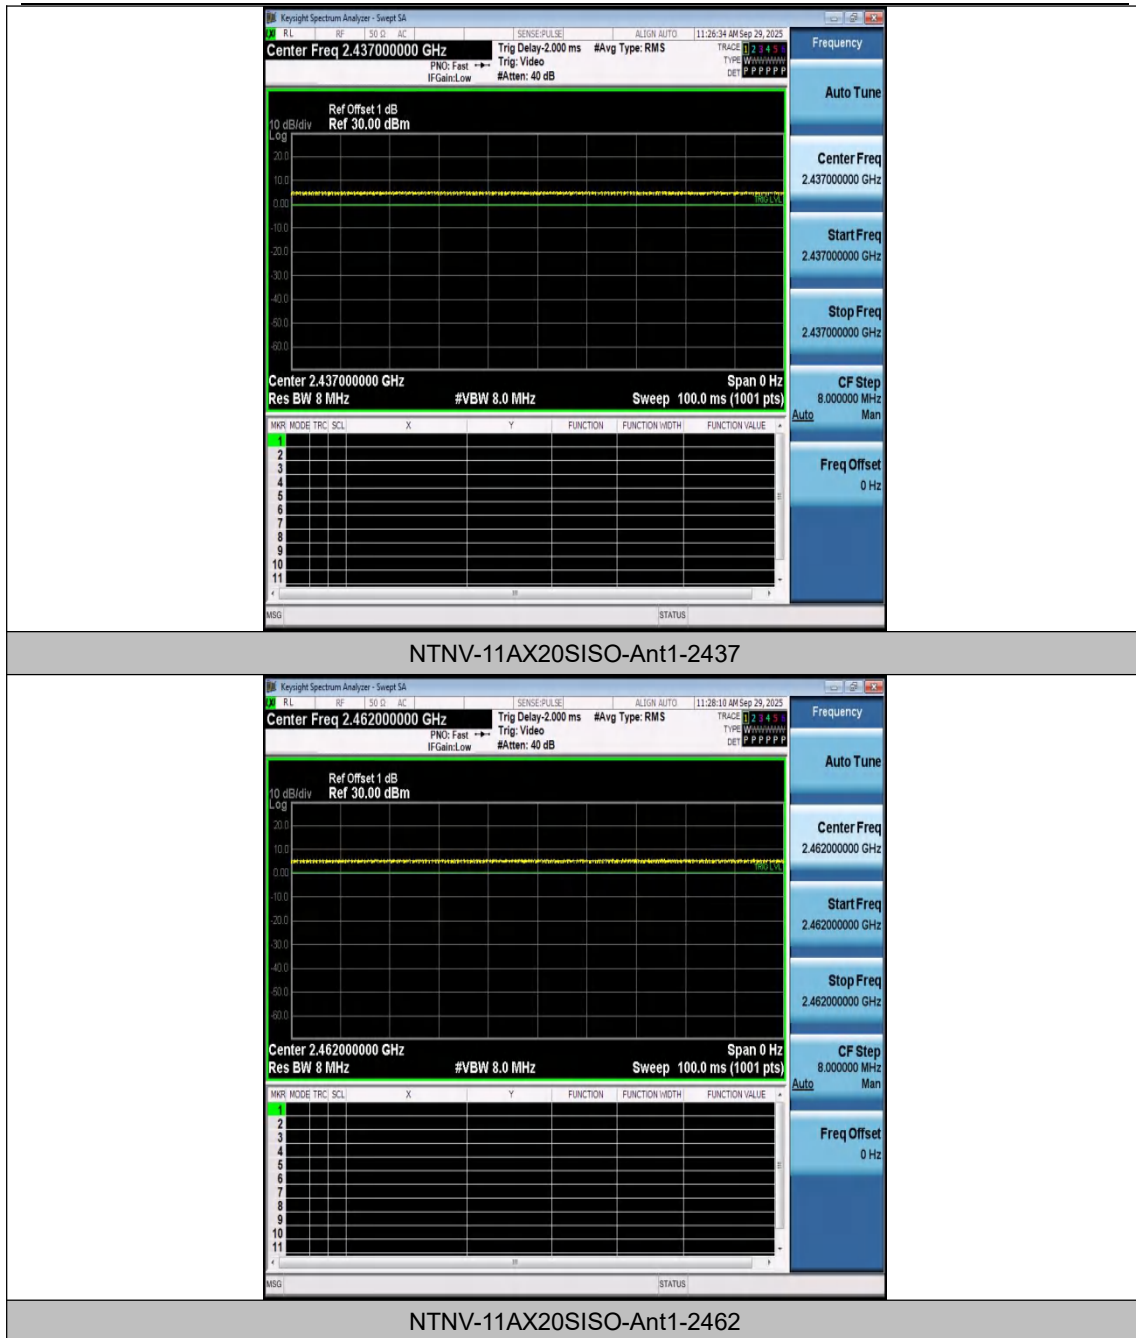

---End---