




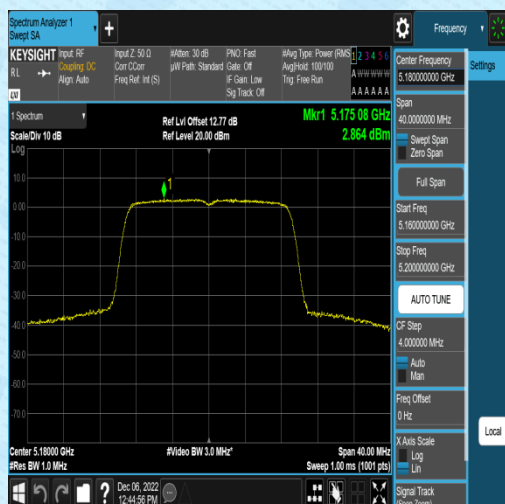


11AC20MIMO-Ant1-5200

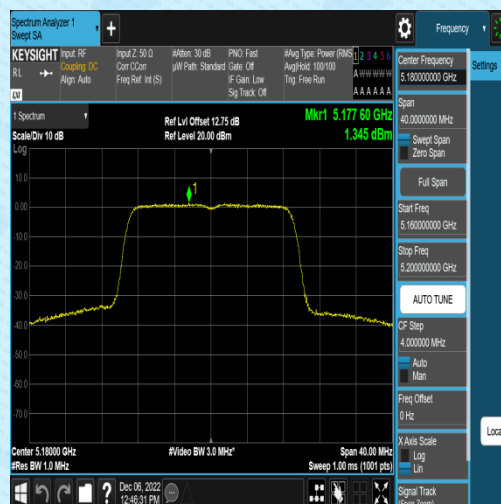


11AC20MIMO-Ant2-5200

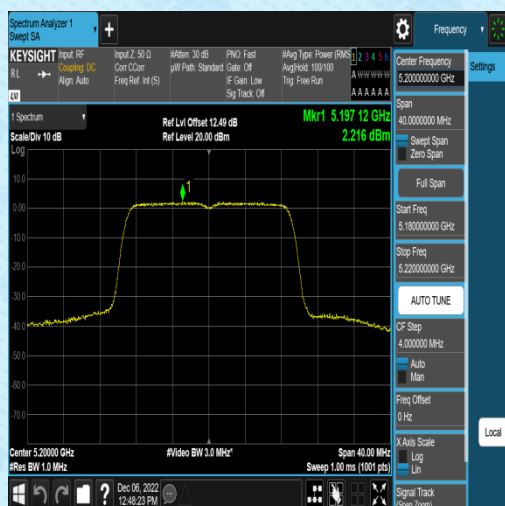


11AC20MIMO-Ant1-5240

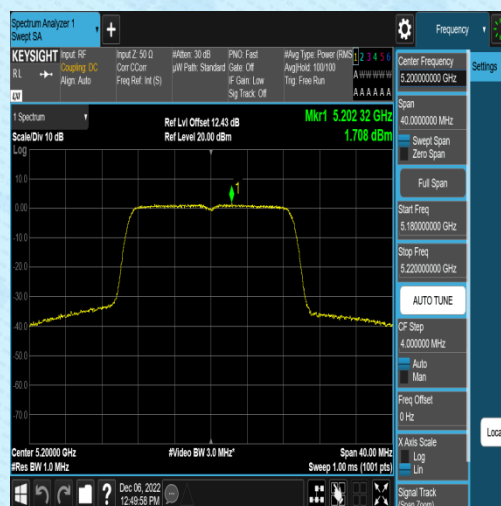



11AC20MIMO-Ant2-5240

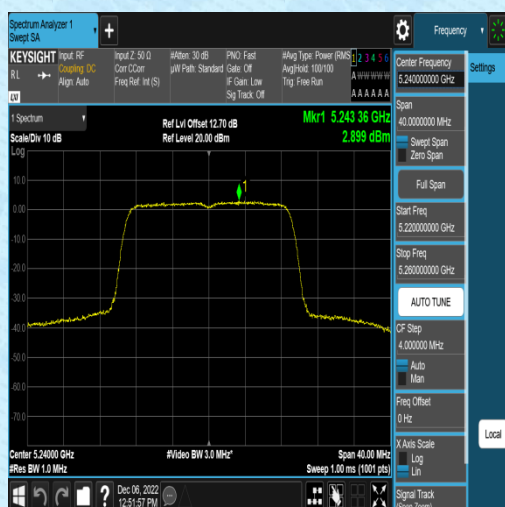

11AC20MIMO-Ant1-5745

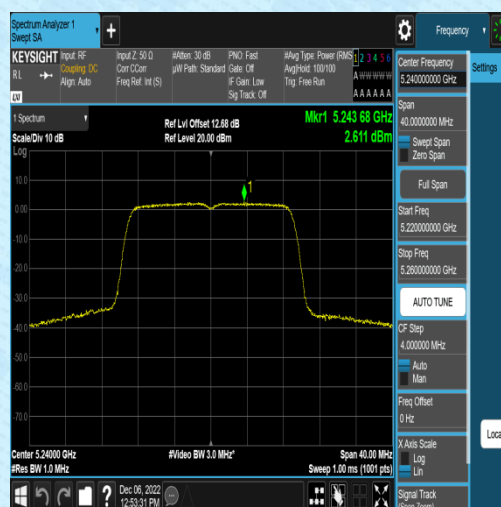


11AC20MIMO-Ant2-5745

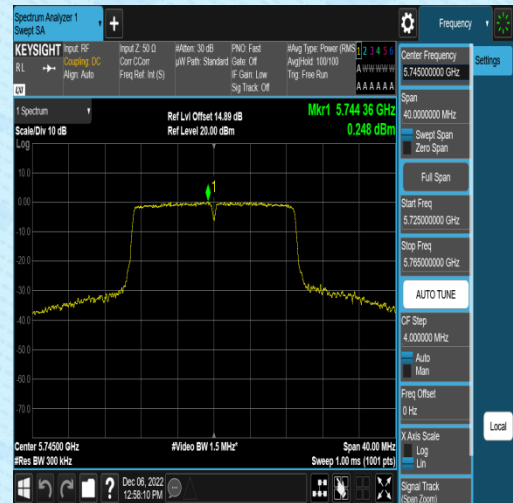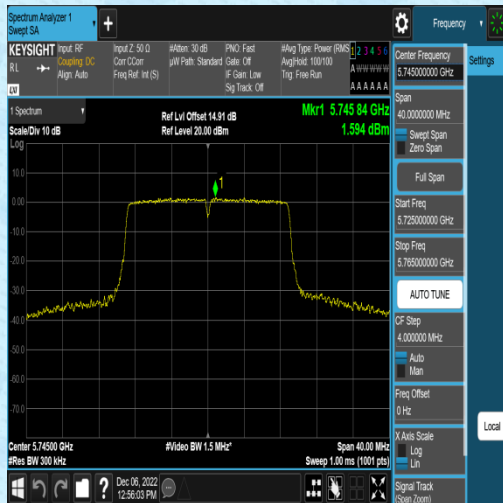



11AC20MIMO-Ant1-5785

11AC20MIMO-Ant2-5785

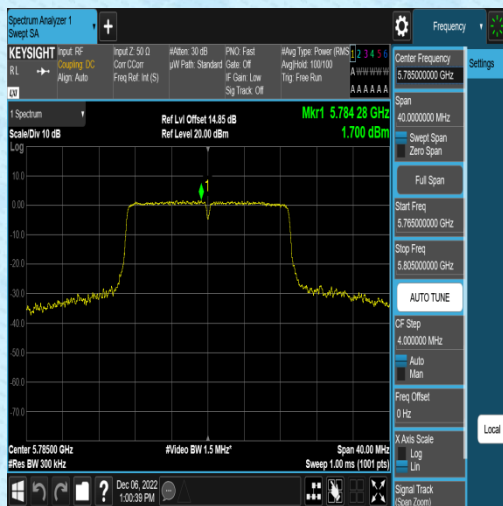



11AC20MIMO-Ant1-5825

11AC20MIMO-Ant2-5825

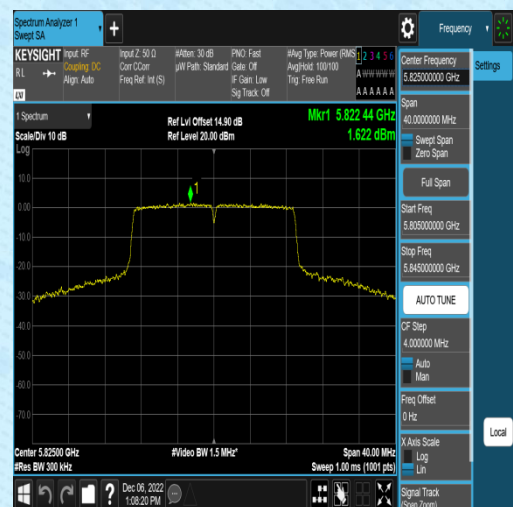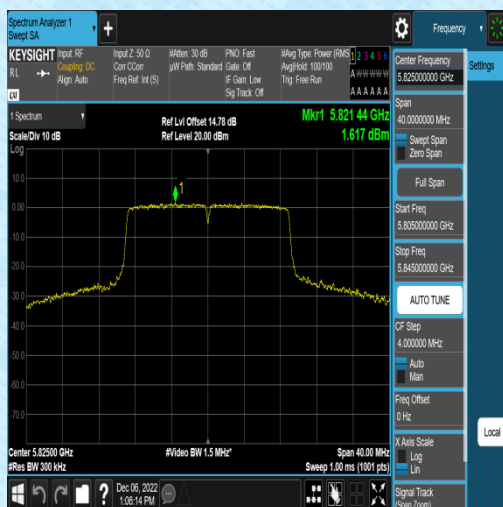


11AC40MIMO-Ant1-5190

11AC40MIMO-Ant2-5190

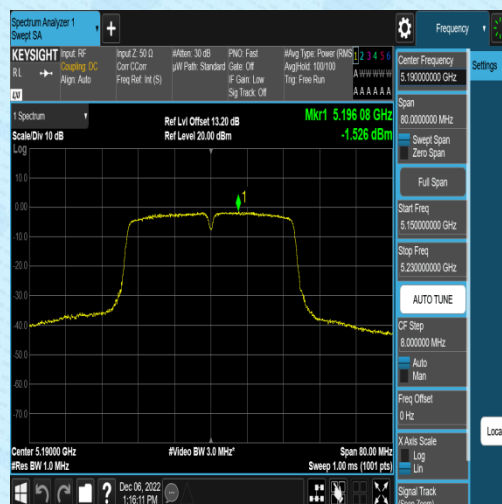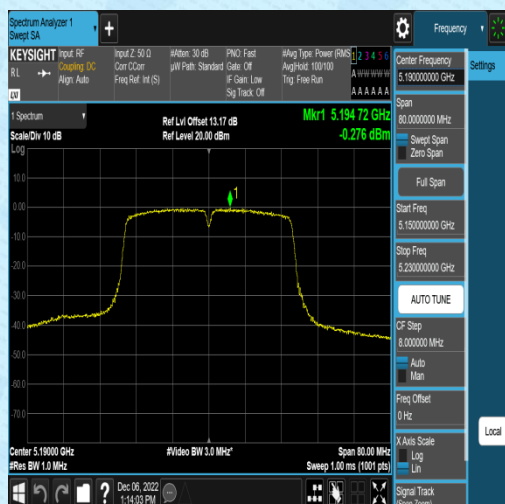



11AC40MIMO-Ant1-5230

11AC40MIMO-Ant2-5230

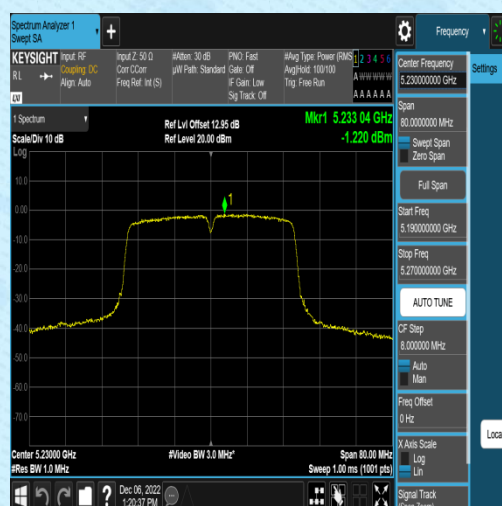







11AC40MIMO-Ant1-5755

11AC40MIMO-Ant2-5755

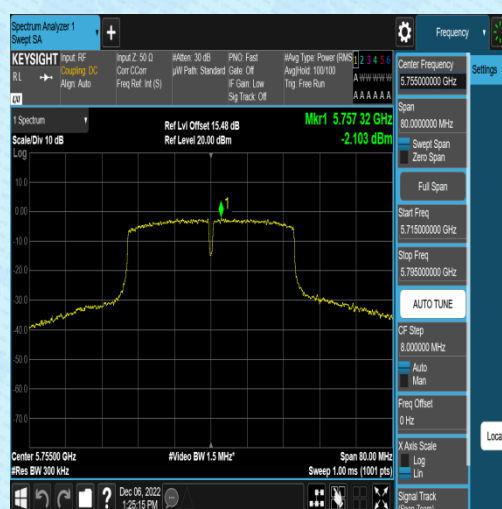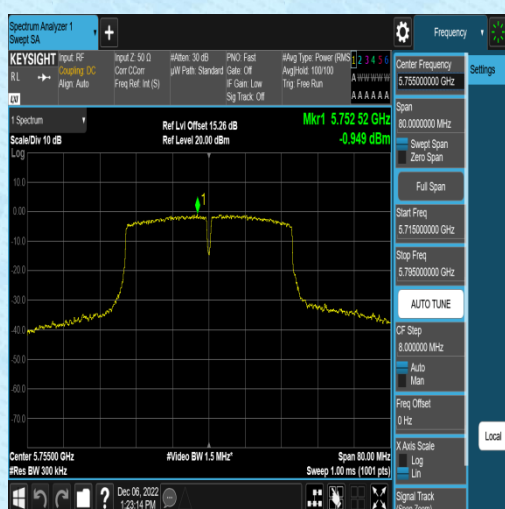

11AC40MIMO-Ant1-5795

11AC40MIMO-Ant2-5795

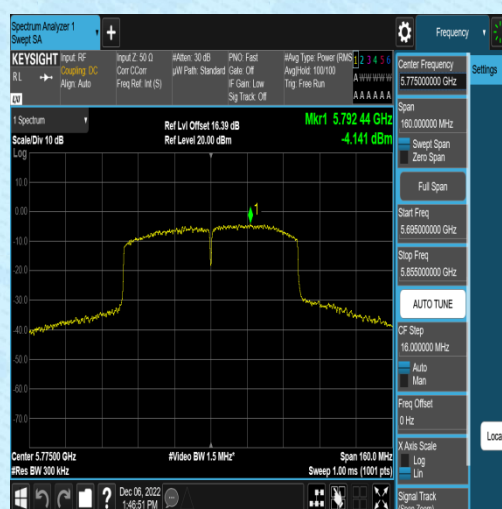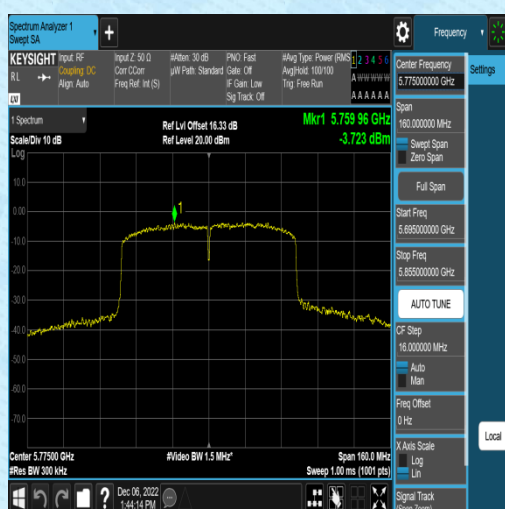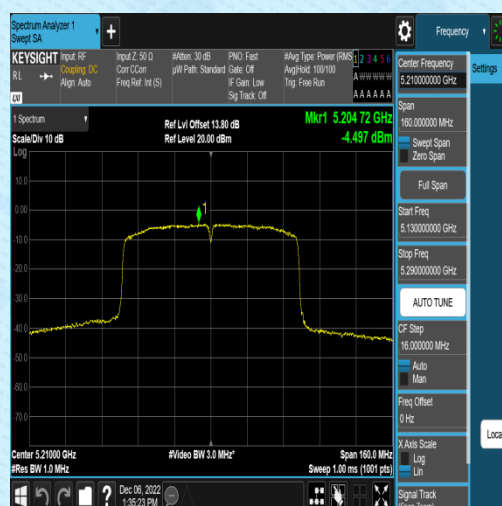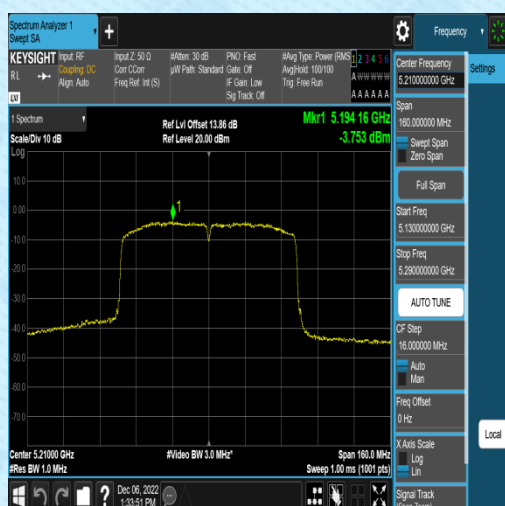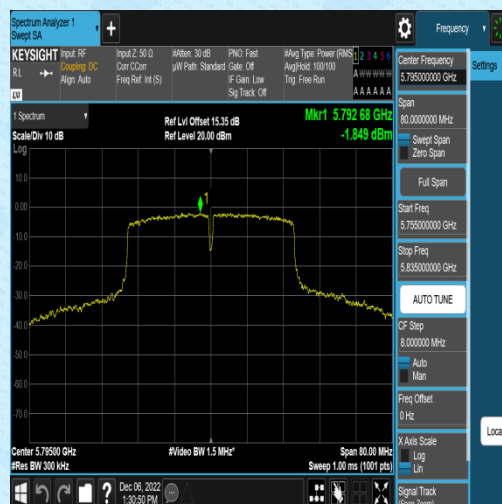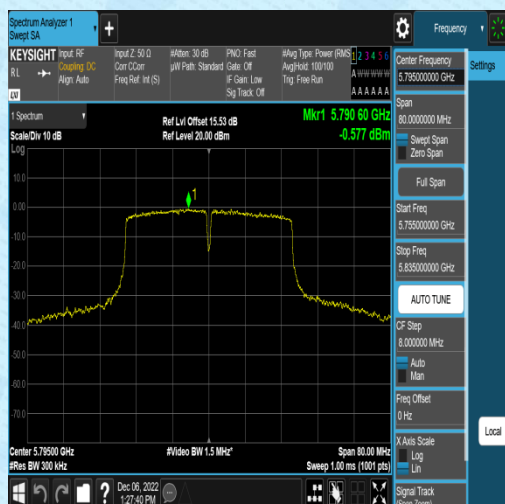

7. Frequency Stability

Test Result

Only show the worst case

Test Condition	Test Mode	Test Frequency [MHz]	Ant	Result [ppm]	Limit [ppm]	Verdict
NTNV	Carrier	5180	1	-5.43	<=20	PASS
NTNV	Carrier	5200	1	-5.32	<=20	PASS
NTNV	Carrier	5240	1	-5.25	<=20	PASS
NTNV	Carrier	5180	2	-5.53	<=20	PASS
NTNV	Carrier	5200	2	-5.59	<=20	PASS
NTNV	Carrier	5240	2	-5.12	<=20	PASS
NTNV	Carrier	5745	1	-4.32	<=20	PASS
NTNV	Carrier	5785	1	-4.21	<=20	PASS
NTNV	Carrier	5805	1	-4.45	<=20	PASS
NTNV	Carrier	5745	2	-7.45	<=20	PASS
NTNV	Carrier	5785	2	-7.54	<=20	PASS
NTNV	Carrier	5805	2	-7.11	<=20	PASS

-----End-----