



NVNT	ac20	5180	Ant2	5150	-41.49	5.58	-	59.32	Peak	68.2	Pass
NVNT	ac20	5180	Ant2	5150	-46.53	5.58	0.11	53.39	Average	54	Pass
NVNT	ac20	5240	Ant2	5350	-50.64	5.58	-	50.17	Peak	68.2	Pass
NVNT	ac20	5240	Ant2	5350	-56.86	5.58	0.11	44.06	Average	54	Pass
NVNT	ac20	5240	Ant2	5439.6	-47.32	5.58	-	53.49	Peak	68.2	Pass
NVNT	ac20	5240	Ant2	5351.04	-56.66	5.58	0.11	44.26	Average	54	Pass
NVNT	ac20	5240	Ant2	5460	-50.53	5.58	-	50.28	Peak	68.2	Pass
NVNT	ac20	5240	Ant2	5460	-57.32	5.58	0.11	43.60	Average	54	Pass
NVNT	ac40	5190	Ant2	4500	-50.32	5.58	-	50.49	Peak	68.2	Pass
NVNT	ac40	5190	Ant2	4500	-58.8	5.58	0.23	42.24	Average	54	Pass
NVNT	ac40	5190	Ant2	5149.7	-40.26	5.58	-	60.55	Peak	68.2	Pass
NVNT	ac40	5190	Ant2	5149.7	-47.18	5.58	0.23	53.86	Average	54	Pass
NVNT	ac40	5190	Ant2	5150	-40.58	5.58	-	60.23	Peak	68.2	Pass
NVNT	ac40	5190	Ant2	5150	-46.92	5.58	0.23	53.12	Average	54	Pass
NVNT	ac40	5230	Ant2	5350	-50.55	5.58	-	50.26	Peak	68.2	Pass
NVNT	ac40	5230	Ant2	5350	-56.8	5.58	0.23	44.24	Average	54	Pass
NVNT	ac40	5230	Ant2	5442.72	-47.87	5.58	-	52.94	Peak	68.2	Pass
NVNT	ac40	5230	Ant2	5350.11	-56.8	5.58	0.23	44.24	Average	54	Pass
NVNT	ac40	5230	Ant2	5460	-51.08	5.58	-	49.73	Peak	68.2	Pass
NVNT	ac40	5230	Ant2	5460	-57.18	5.58	0.23	43.86	Average	54	Pass
NVNT	ac80	5210	Ant2	5350	-49.32	5.58	-	51.49	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5350	-55.97	5.58	0.47	45.31	Average	54	Pass
NVNT	ac80	5210	Ant2	5426.67	-46.87	5.58	-	53.94	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5351.43	-55.85	5.58	0.47	45.43	Average	54	Pass
NVNT	ac80	5210	Ant2	5460	-48.96	5.58	-	51.85	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5460	-56.61	5.58	0.47	44.67	Average	54	Pass
NVNT	ac80	5210	Ant2	4500	-51.58	5.58	-	49.23	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	4500	-58.66	5.58	0.47	42.62	Average	54	Pass
NVNT	ac80	5210	Ant2	5149.38	-40.86	5.58	-	59.95	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5149.38	-45.84	5.58	0.47	53.44	Average	54	Pass
NVNT	ac80	5210	Ant2	5150	-42.58	5.58	-	58.23	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5150	-45.71	5.58	0.47	53.57	Average	54	Pass
NVNT	ax20	5180	Ant2	4500	-51.57	5.58	-	49.24	Peak	68.2	Pass
NVNT	ax20	5180	Ant2	4500	-59.04	5.58	0.13	41.90	Average	54	Pass
NVNT	ax20	5180	Ant2	5148.9	-39.15	5.58	-	61.66	Peak	68.2	Pass
NVNT	ax20	5180	Ant2	5149.6	-47.08	5.58	0.13	53.86	Average	54	Pass
NVNT	ax20	5180	Ant2	5150	-42.32	5.58	-	58.49	Peak	68.2	Pass
NVNT	ax20	5180	Ant2	5150	-46.61	5.58	0.13	53.33	Average	54	Pass
NVNT	ax20	5240	Ant2	5350	-50.45	5.58	-	50.36	Peak	68.2	Pass
NVNT	ax20	5240	Ant2	5350	-56.86	5.58	0.11	44.06	Average	54	Pass
NVNT	ax20	5240	Ant2	5433.12	-47.32	5.58	-	53.49	Peak	68.2	Pass
NVNT	ax20	5240	Ant2	5351.28	-56.67	5.58	0.11	44.25	Average	54	Pass
NVNT	ax20	5240	Ant2	5460	-48.37	5.58	-	52.44	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax20	5240	Ant2	5460	-57.33	5.58	0.11	43.59	Average	54	Pass
NVNT	ax40	5190	Ant2	4500	-51.02	5.58	-	49.79	Peak	68.2	Pass
NVNT	ax40	5190	Ant2	4500	-58.83	5.58	0.27	42.25	Average	54	Pass
NVNT	ax40	5190	Ant2	5148.24	-39.78	5.58	-	61.03	Peak	68.2	Pass
NVNT	ax40	5190	Ant2	5149.7	-47.57	5.58	0.27	53.51	Average	54	Pass
NVNT	ax40	5190	Ant2	5150	-40.95	5.58	-	59.86	Peak	68.2	Pass
NVNT	ax40	5190	Ant2	5150	-47.16	5.58	0.27	53.92	Average	54	Pass
NVNT	ax40	5230	Ant2	5350	-50.86	5.58	-	49.95	Peak	68.2	Pass
NVNT	ax40	5230	Ant2	5350	-57.13	5.58	0.23	43.91	Average	54	Pass
NVNT	ax40	5230	Ant2	5450.55	-47.73	5.58	-	53.08	Peak	68.2	Pass
NVNT	ax40	5230	Ant2	5426.52	-56.87	5.58	0.23	44.17	Average	54	Pass
NVNT	ax40	5230	Ant2	5460	-49.12	5.58	-	51.69	Peak	68.2	Pass
NVNT	ax40	5230	Ant2	5460	-57.15	5.58	0.23	43.89	Average	54	Pass
NVNT	ax80	5210	Ant2	5350	-49.15	5.58	-	51.66	Peak	68.2	Pass
NVNT	ax80	5210	Ant2	5350	-55.99	5.58	0.46	45.28	Average	54	Pass
NVNT	ax80	5210	Ant2	5430.3	-47.1	5.58	-	53.71	Peak	68.2	Pass
NVNT	ax80	5210	Ant2	5350.44	-55.77	5.58	0.46	45.50	Average	54	Pass
NVNT	ax80	5210	Ant2	5460	-49.75	5.58	-	51.06	Peak	68.2	Pass
NVNT	ax80	5210	Ant2	5460	-56.8	5.58	0.46	44.47	Average	54	Pass
NVNT	ax80	5210	Ant2	4500	-51.65	5.58	-	49.16	Peak	68.2	Pass
NVNT	ax80	5210	Ant2	4500	-58.49	5.58	0.46	42.78	Average	54	Pass
NVNT	ax80	5210	Ant2	5149.38	-41.02	5.58	-	59.79	Peak	68.2	Pass
NVNT	ax80	5210	Ant2	5149.38	-45.56	5.58	0.46	53.71	Average	54	Pass
NVNT	ax80	5210	Ant2	5150	-39.13	5.58	-	61.68	Peak	68.2	Pass
NVNT	ax80	5210	Ant2	5150	-45.67	5.58	0.46	55.60	Average	54	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

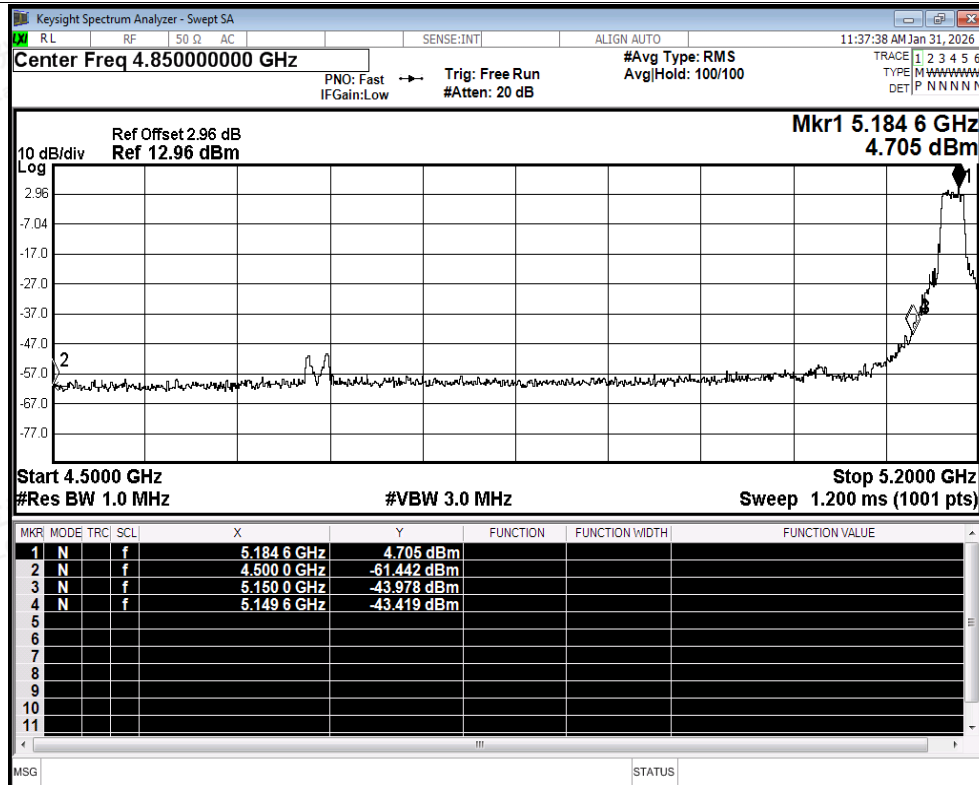

Restrict Band NVNT a 5180MHz Ant2 Peak

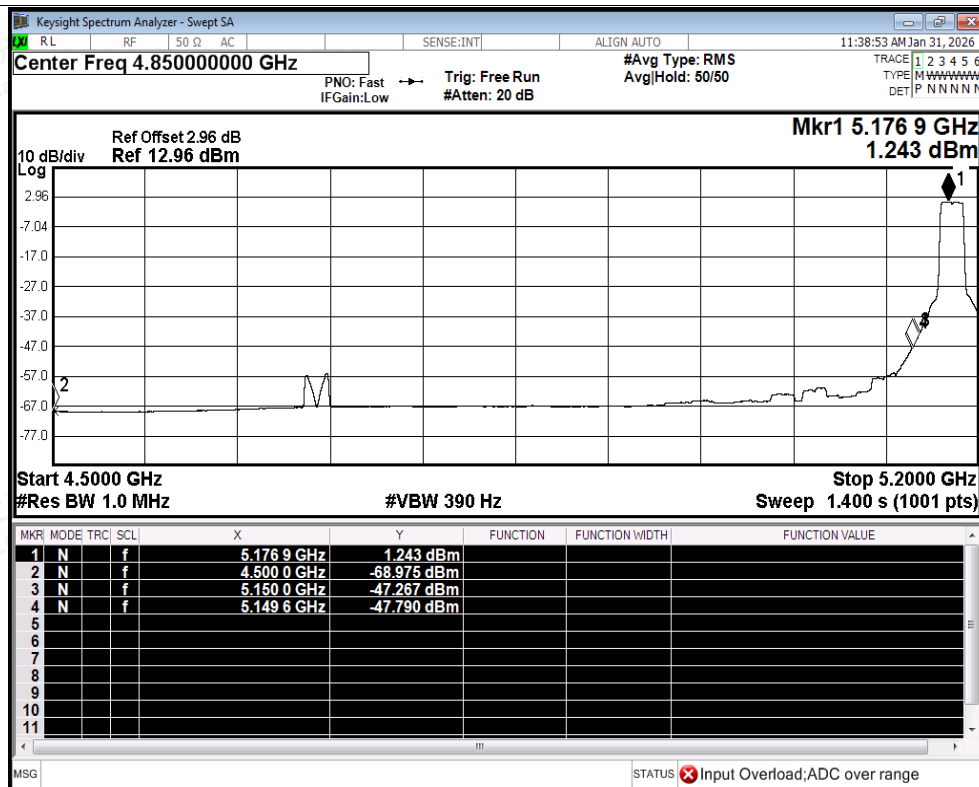

Restrict Band NVNT a 5180MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

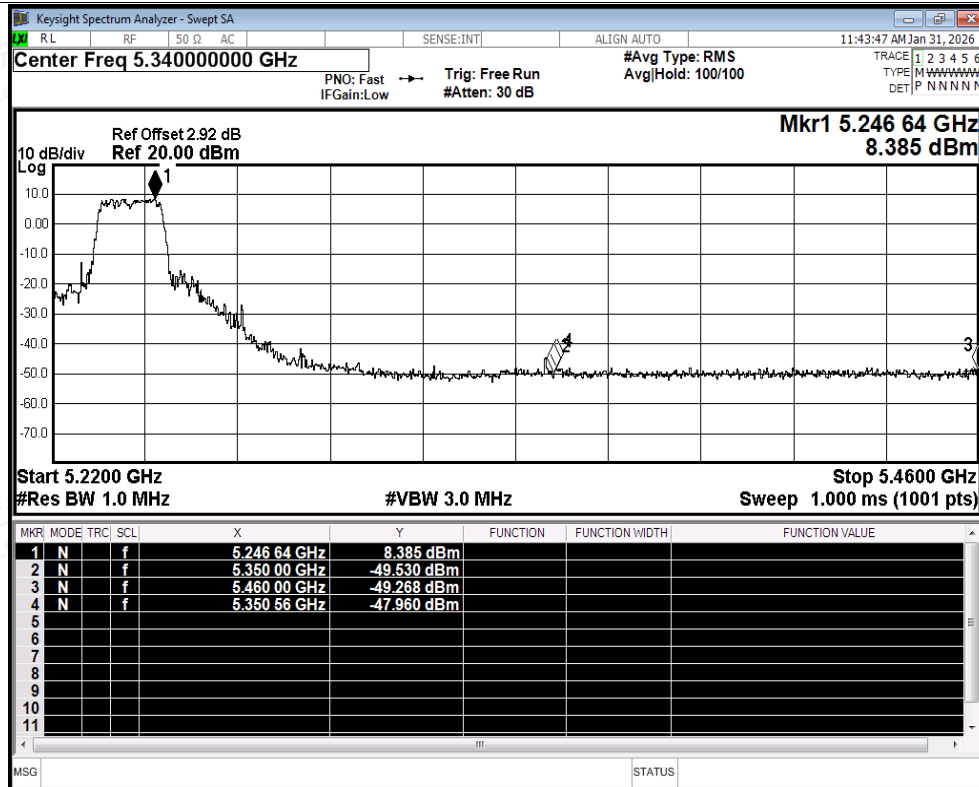

Restrict Band NVNT a 5240MHz Ant2 Peak

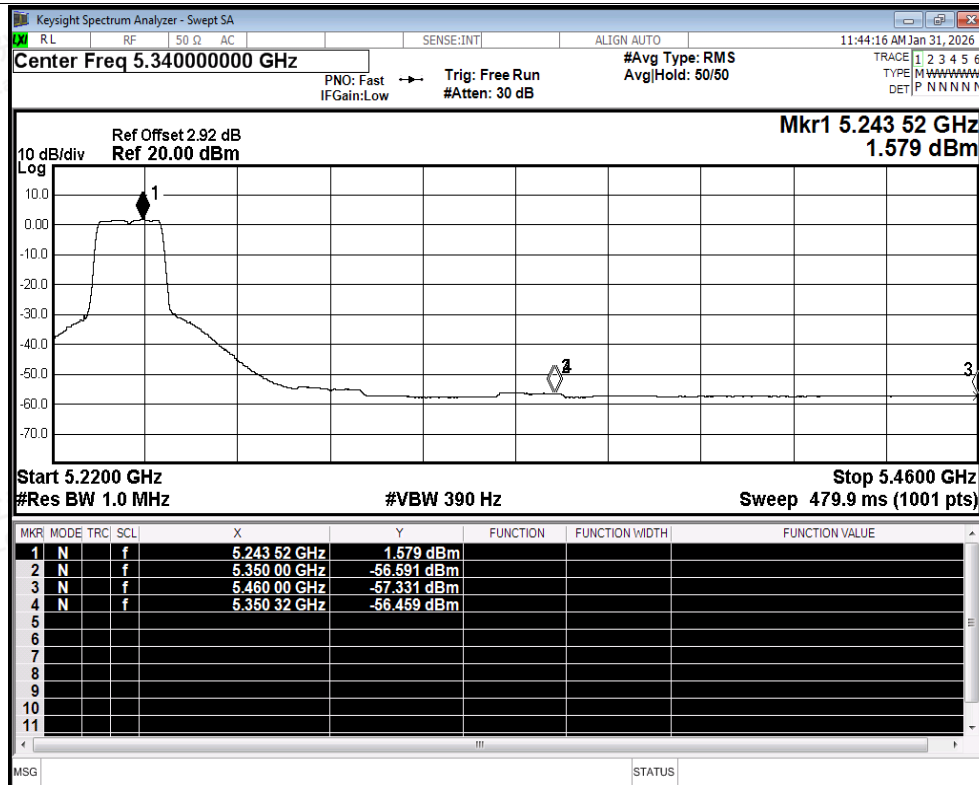

Restrict Band NVNT a 5240MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

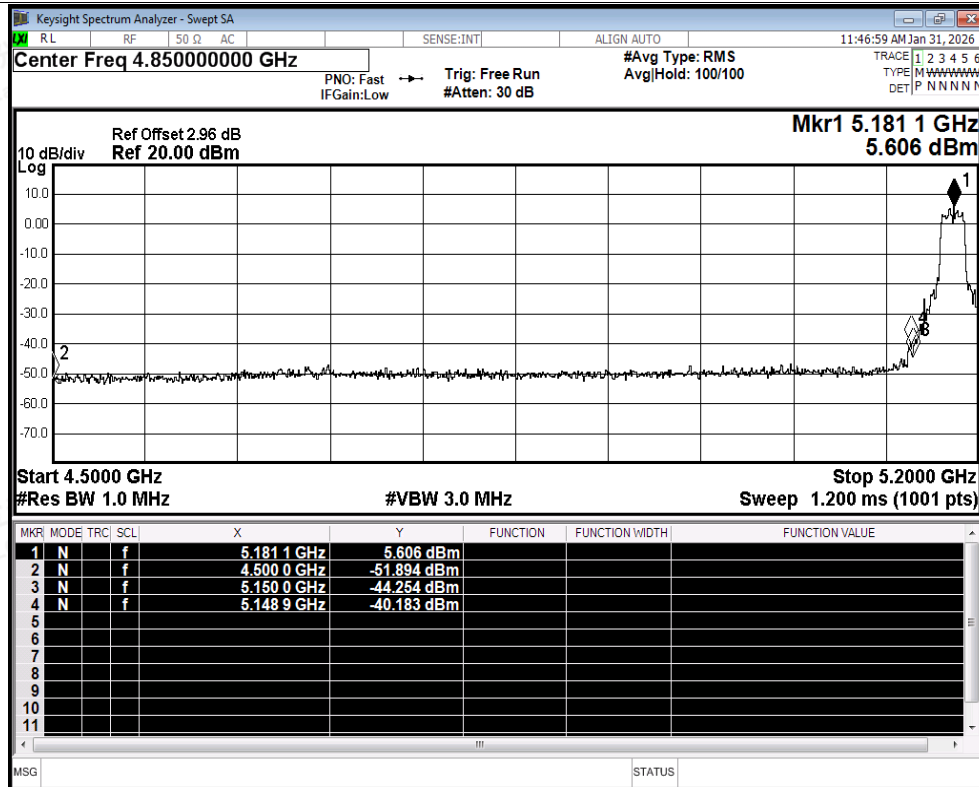

Restrict Band NVNT n20 5180MHz Ant2 Peak

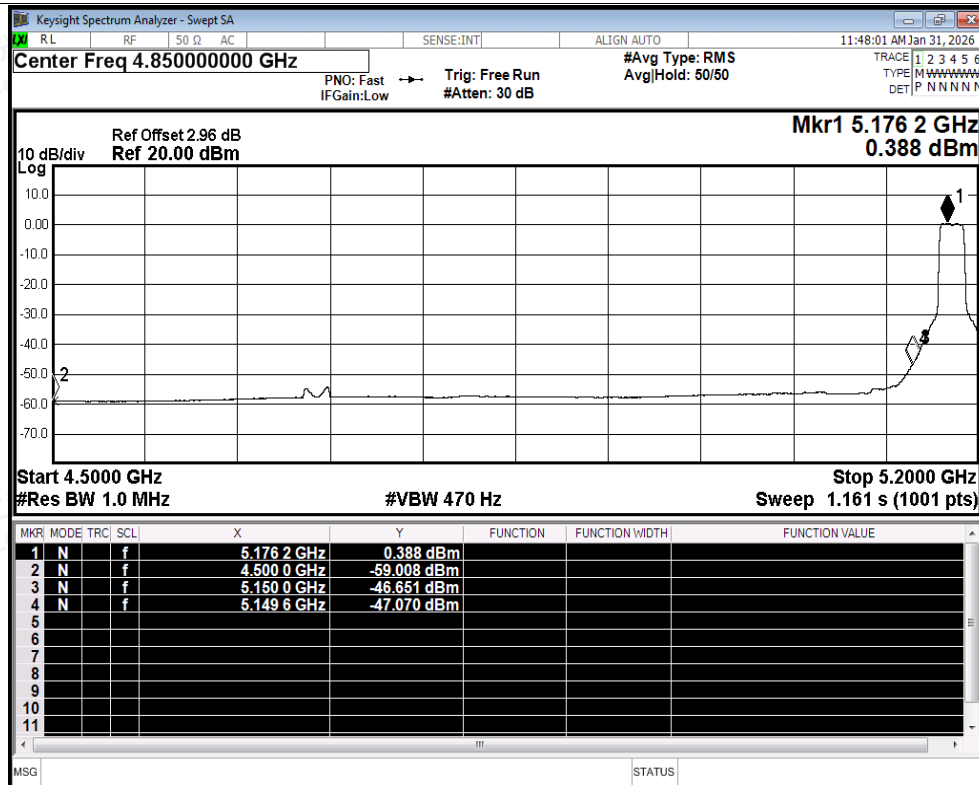

Restrict Band NVNT n20 5180MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

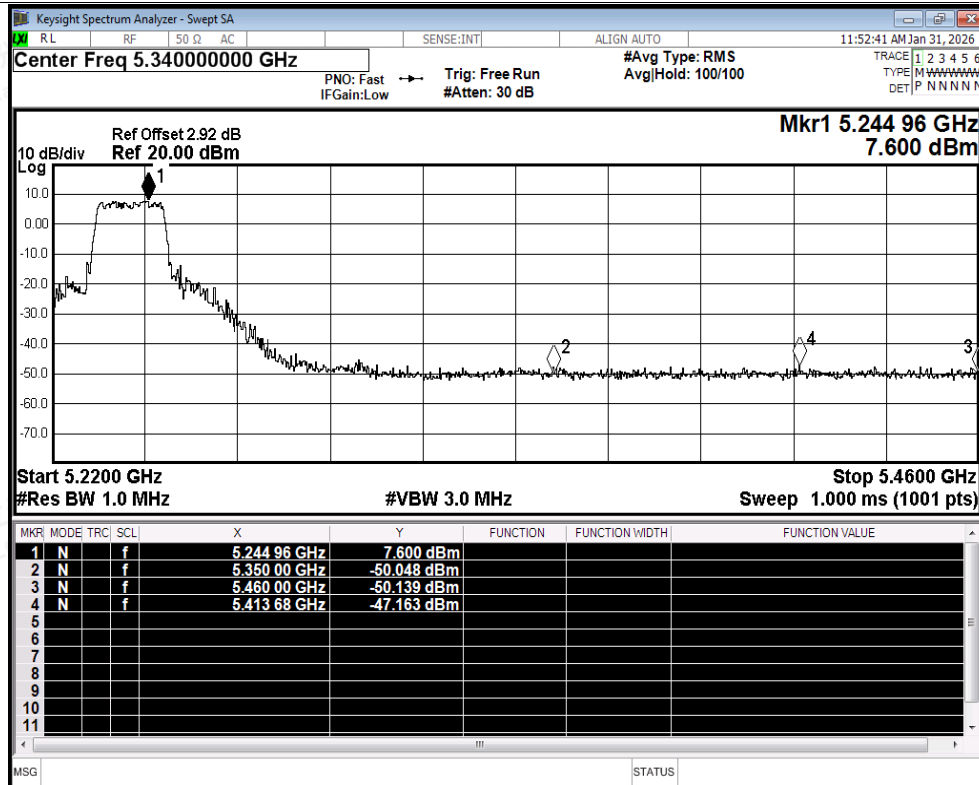


Restrict Band NVNT n20 5240MHz Ant2 Peak

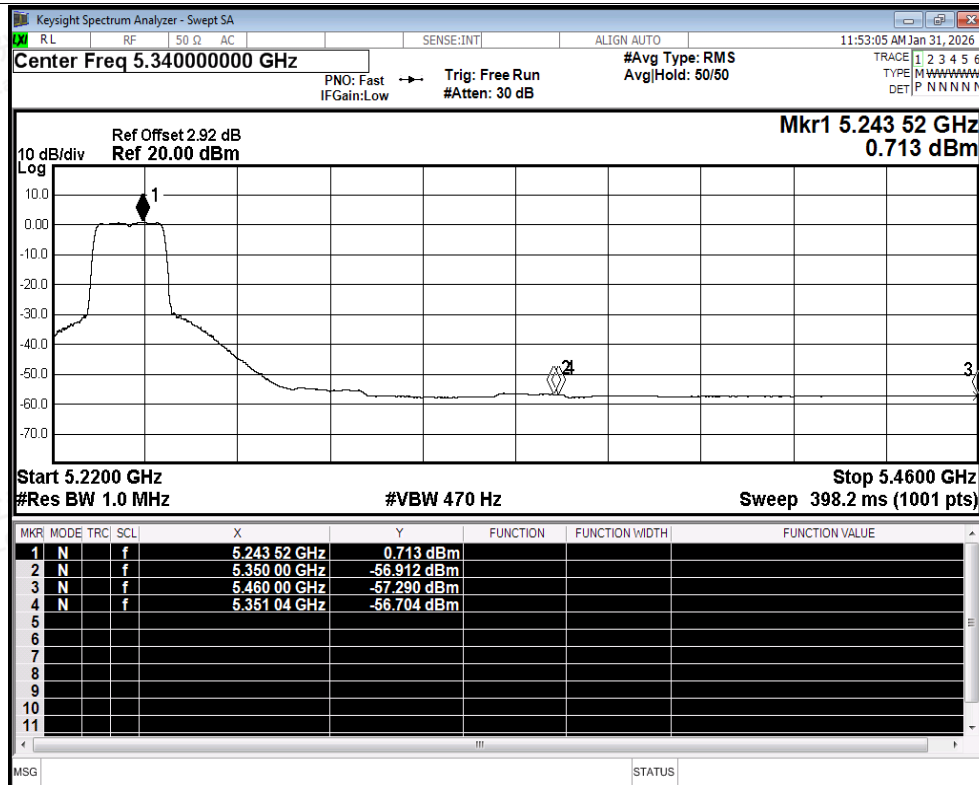


Restrict Band NVNT n20 5240MHz Ant2 Average



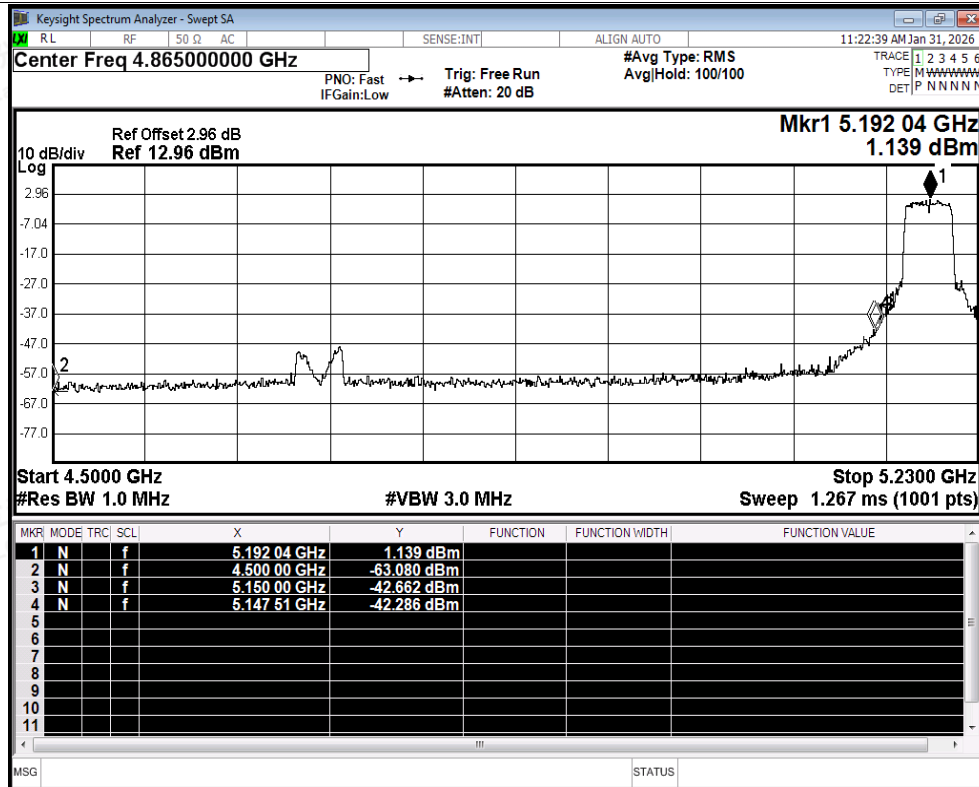

Restrict Band NVNT n40 5190MHz Ant2 Peak

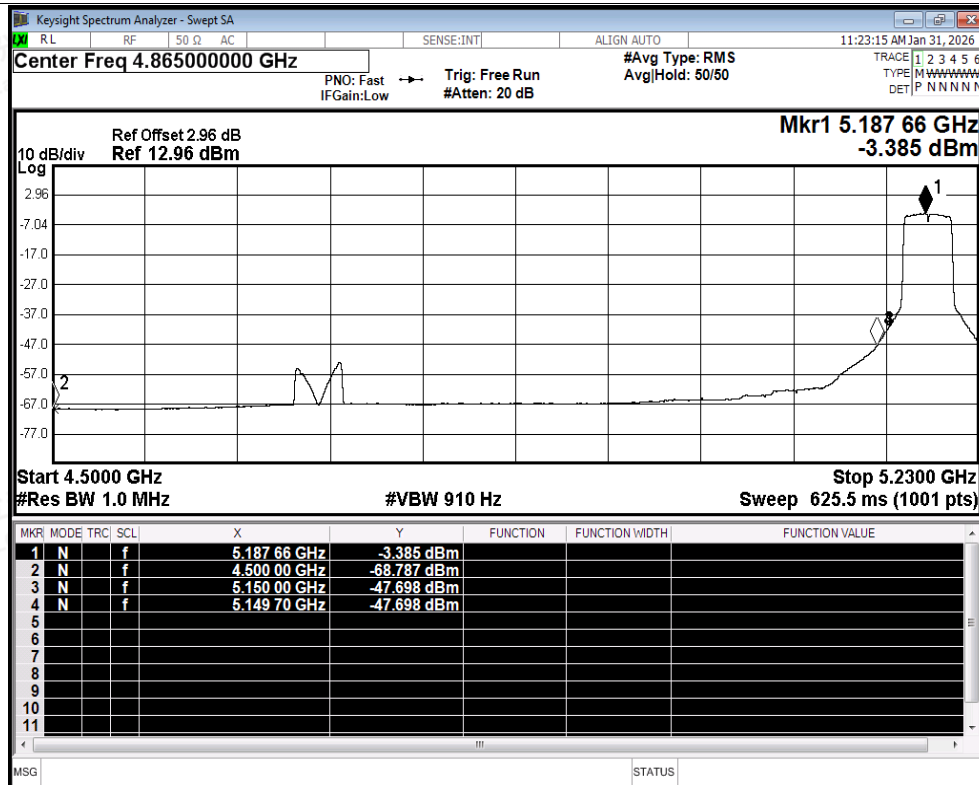

Restrict Band NVNT n40 5190MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

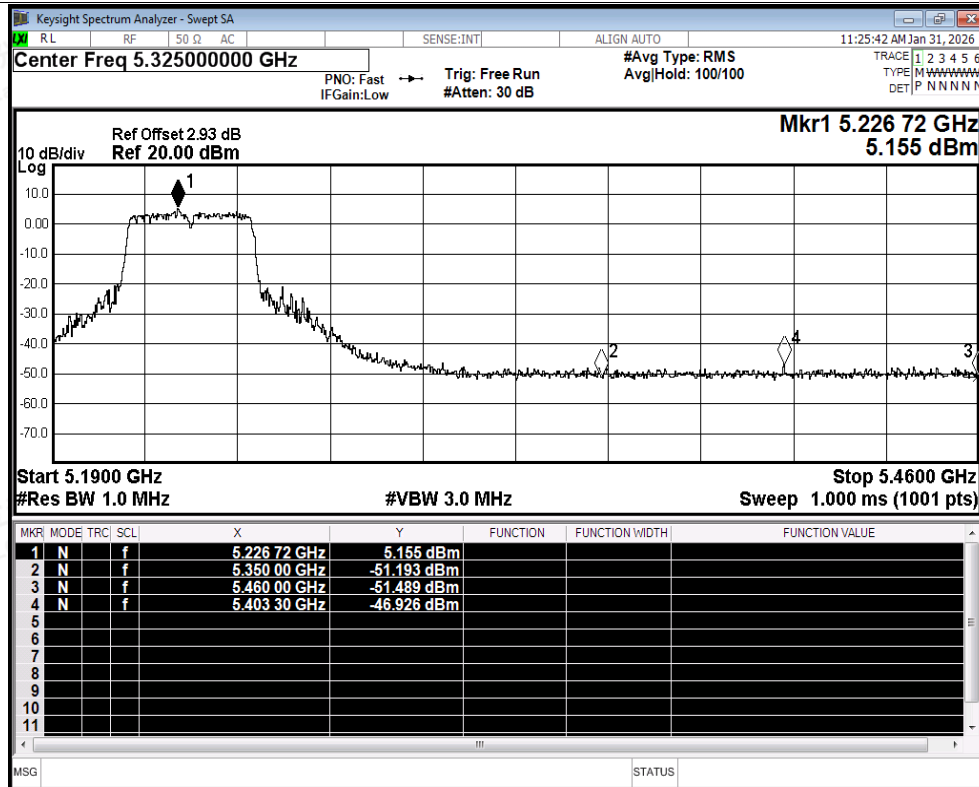

Restrict Band NVNT n40 5230MHz Ant2 Peak

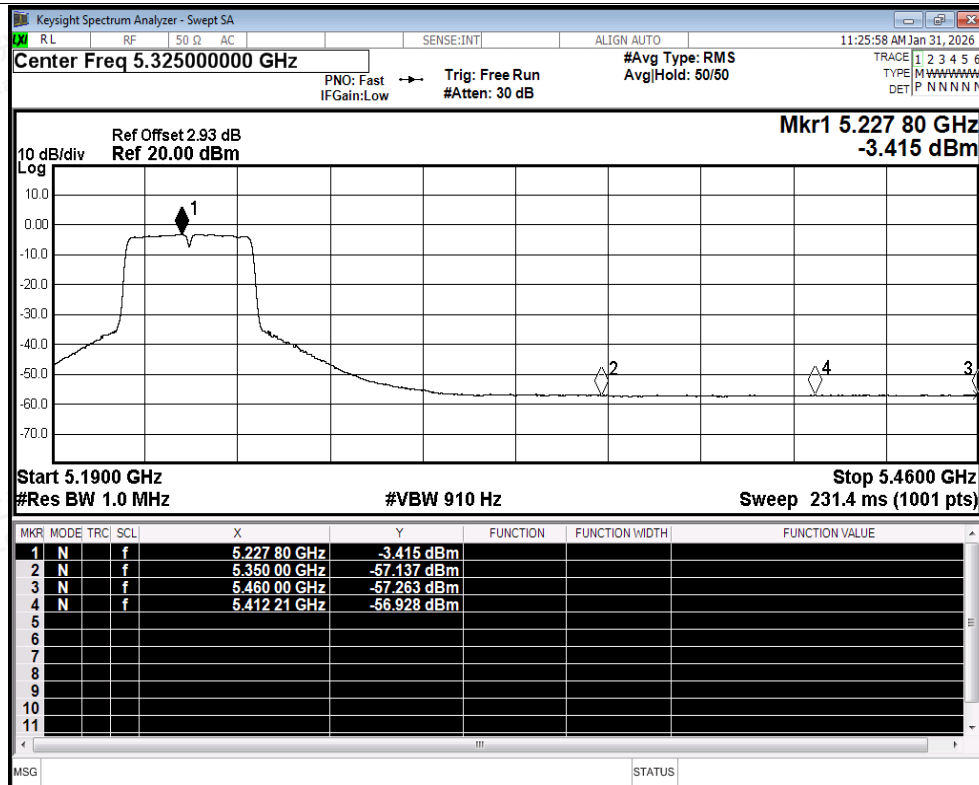

Restrict Band NVNT n40 5230MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

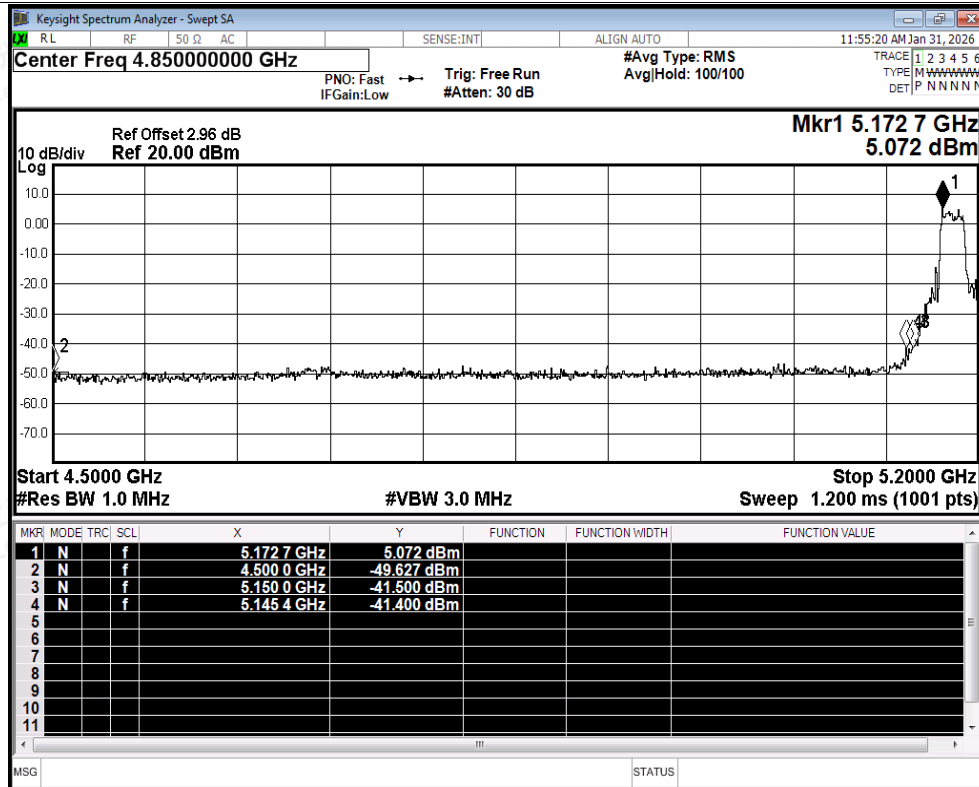

Restrict Band NVNT ac20 5180MHz Ant2 Peak

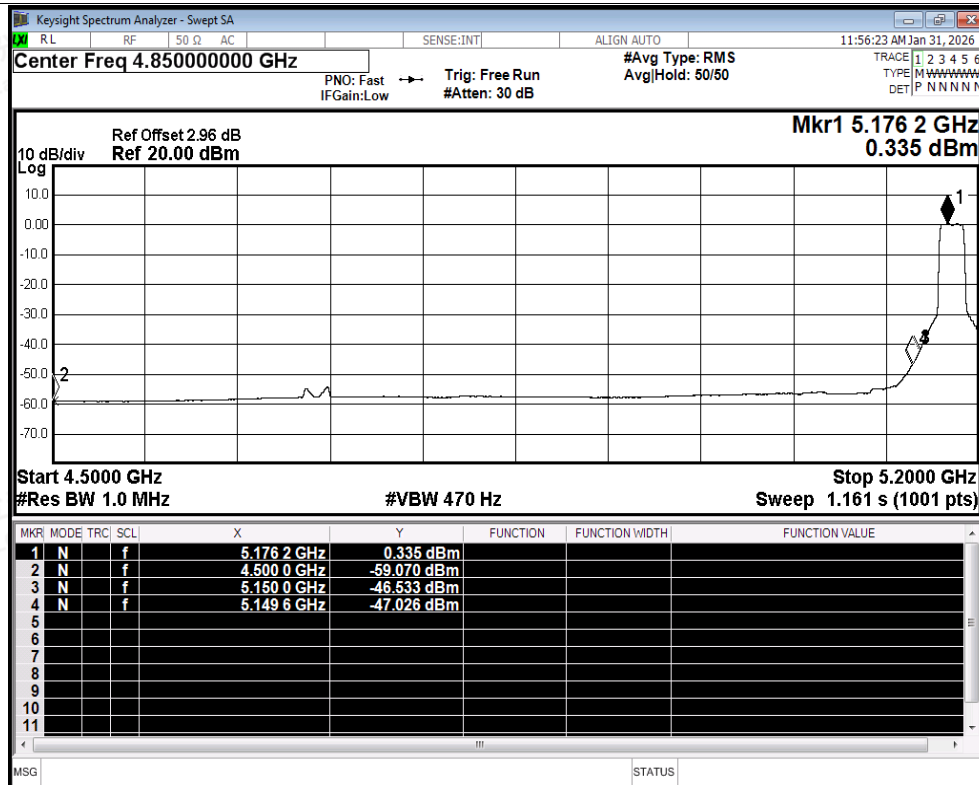

Restrict Band NVNT ac20 5180MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

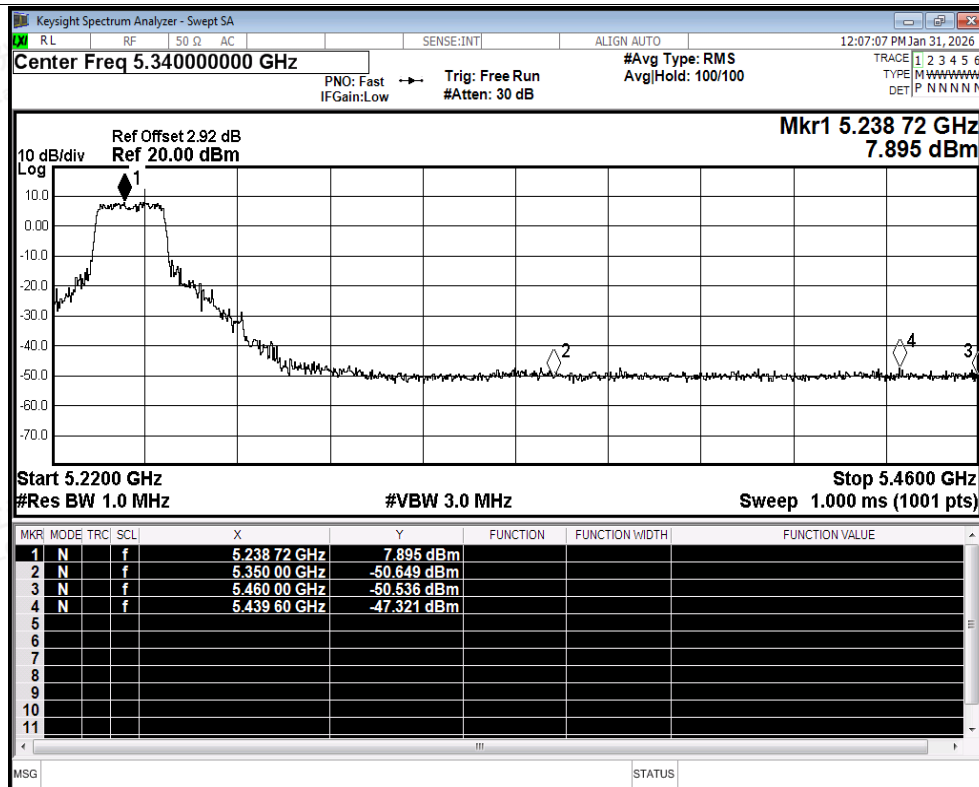


Restrict Band NVNT ac20 5240MHz Ant2 Peak

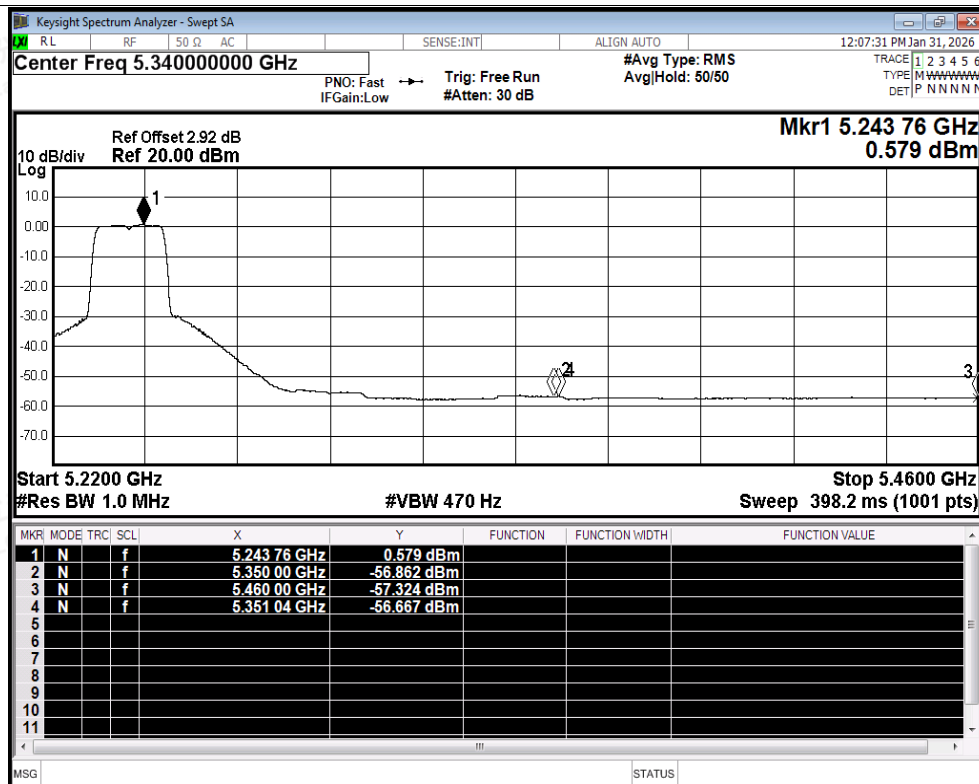


Restrict Band NVNT ac20 5240MHz Ant2 Average



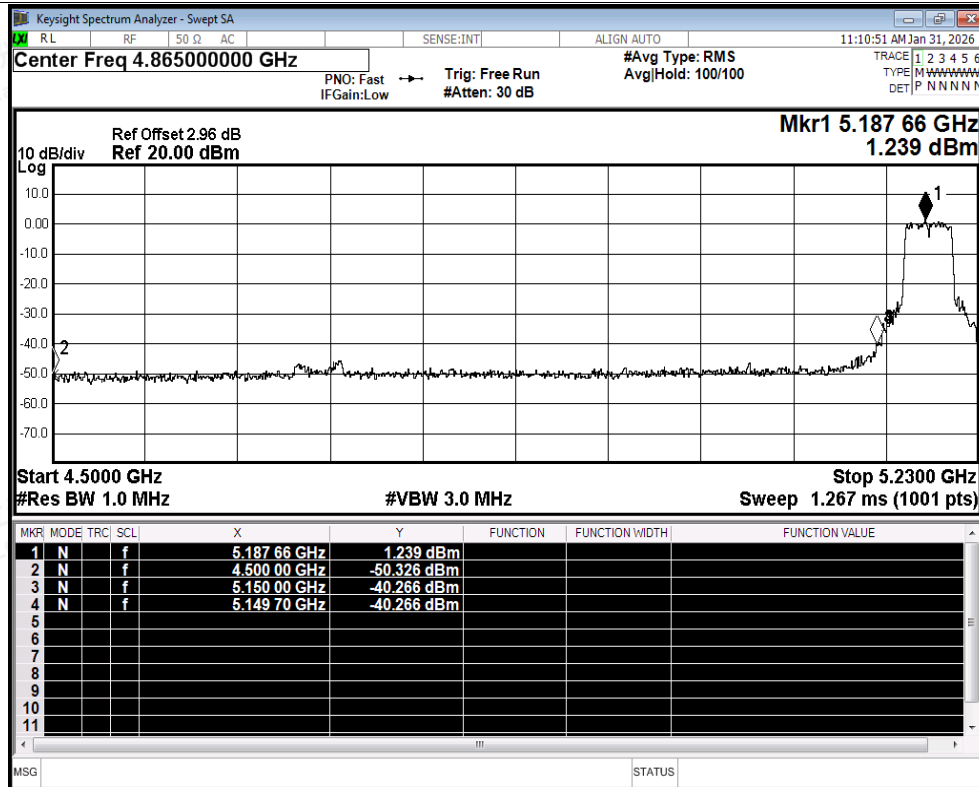

Restrict Band NVNT ac40 5190MHz Ant2 Peak

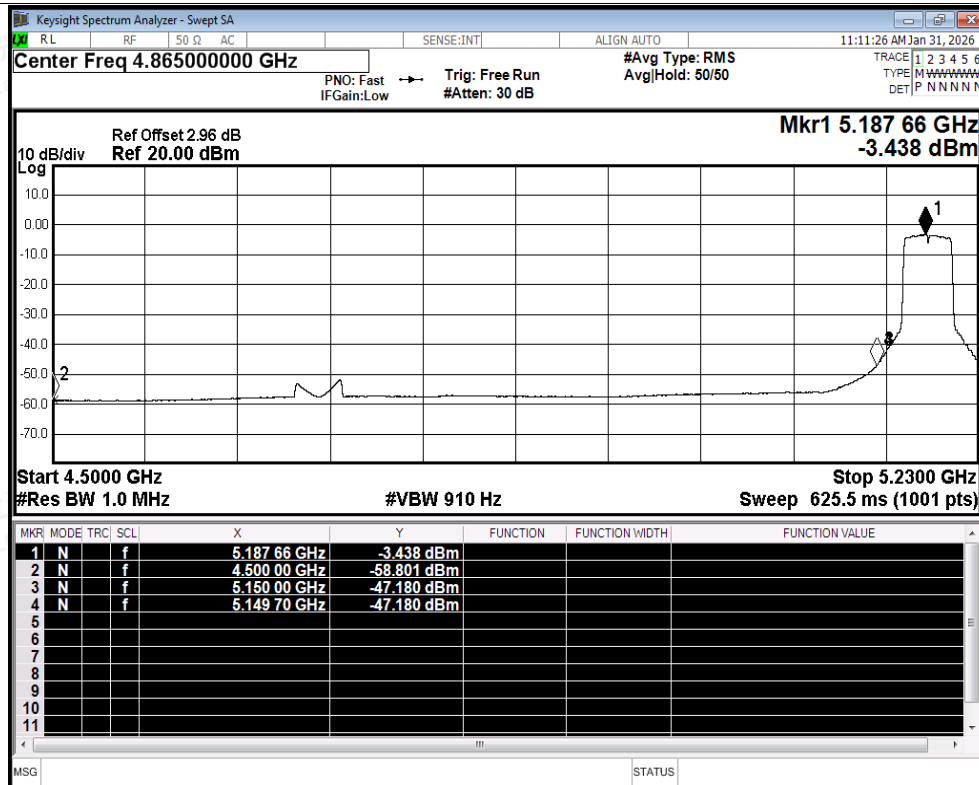

Restrict Band NVNT ac40 5190MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

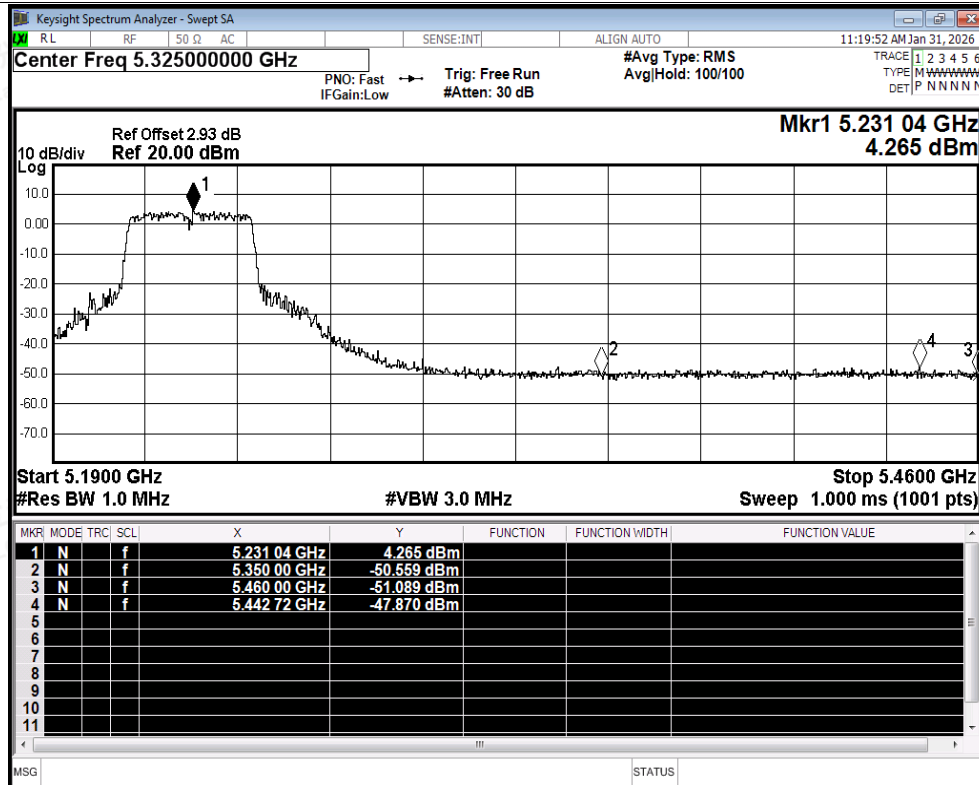


Restrict Band NVNT ac40 5230MHz Ant2 Peak

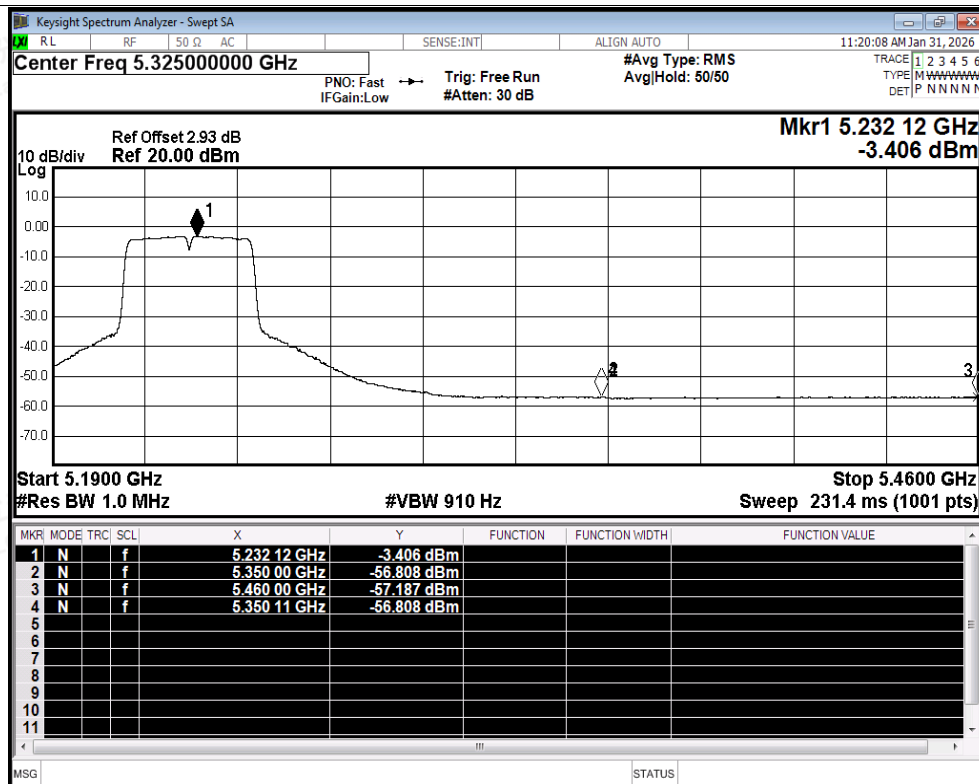


Restrict Band NVNT ac40 5230MHz Ant2 Average



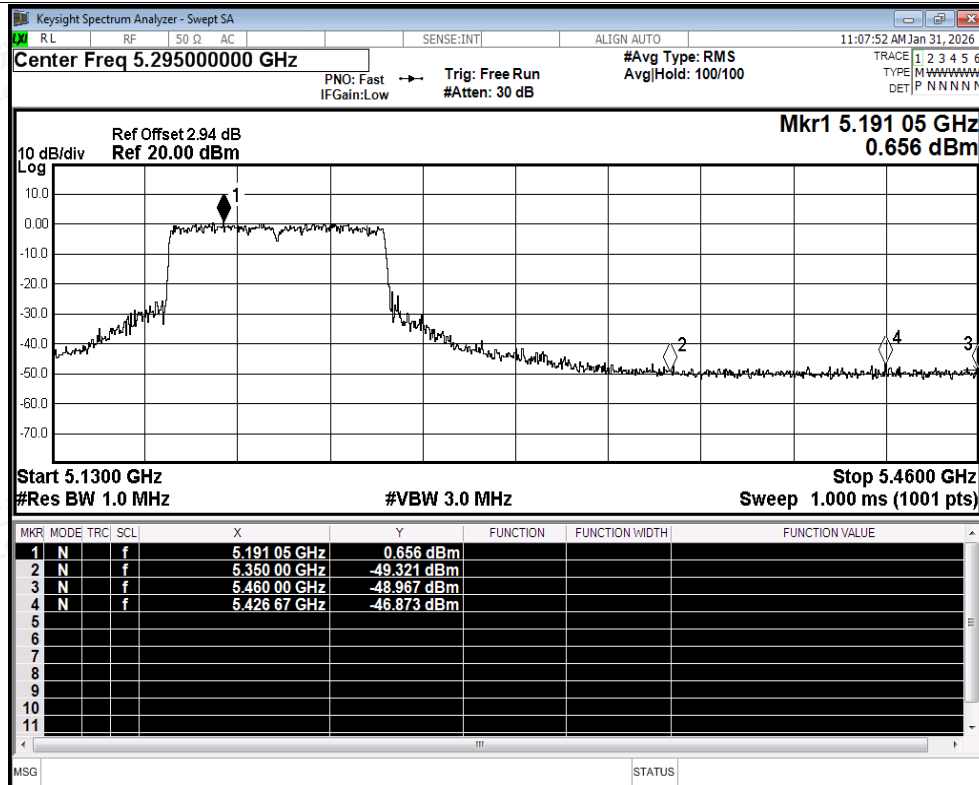

Restrict Band NVNT ac80 5210MHz Ant2 Peak

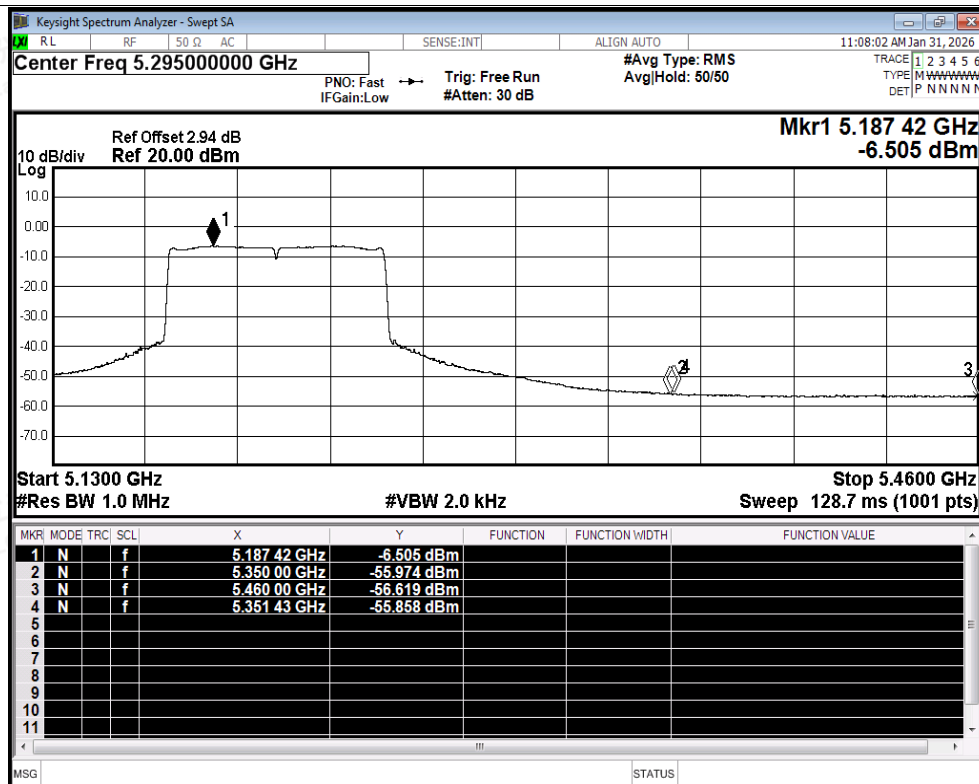

Restrict Band NVNT ac80 5210MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

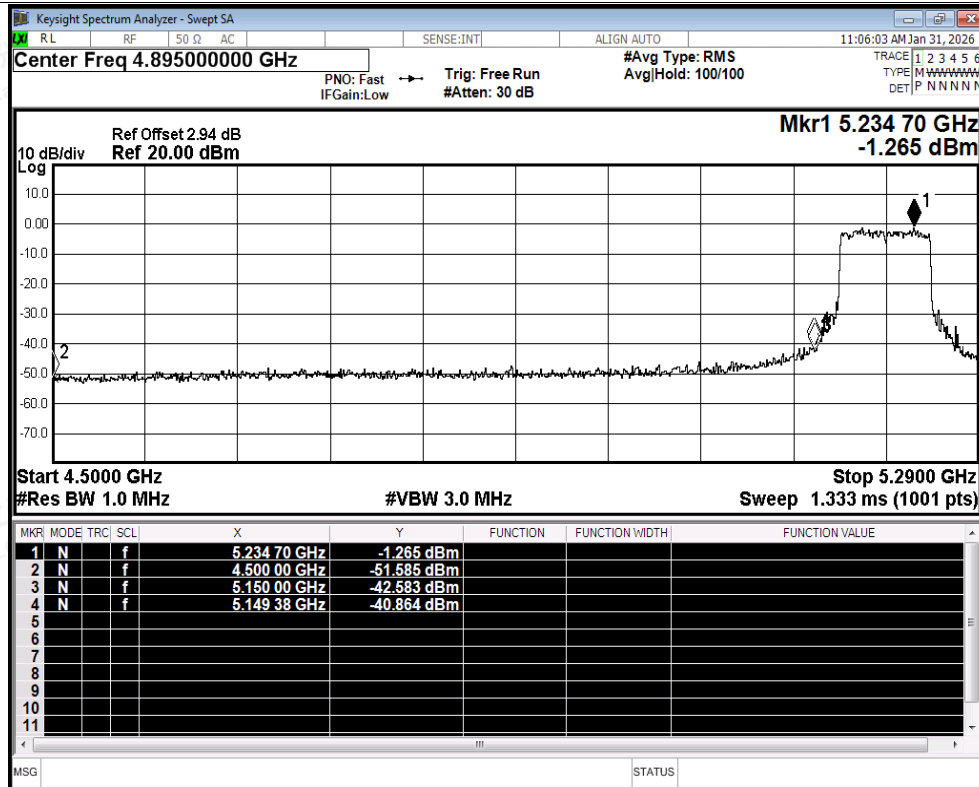

Restrict Band NVNT ac80 5210MHz Ant2 Peak

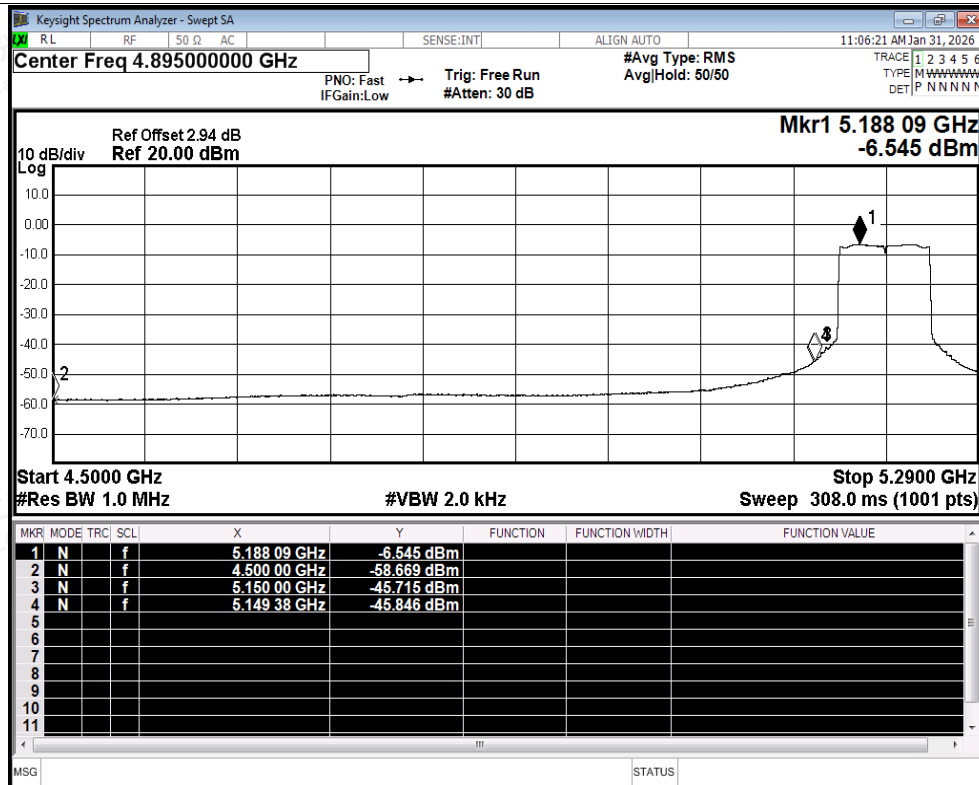

Restrict Band NVNT ac80 5210MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

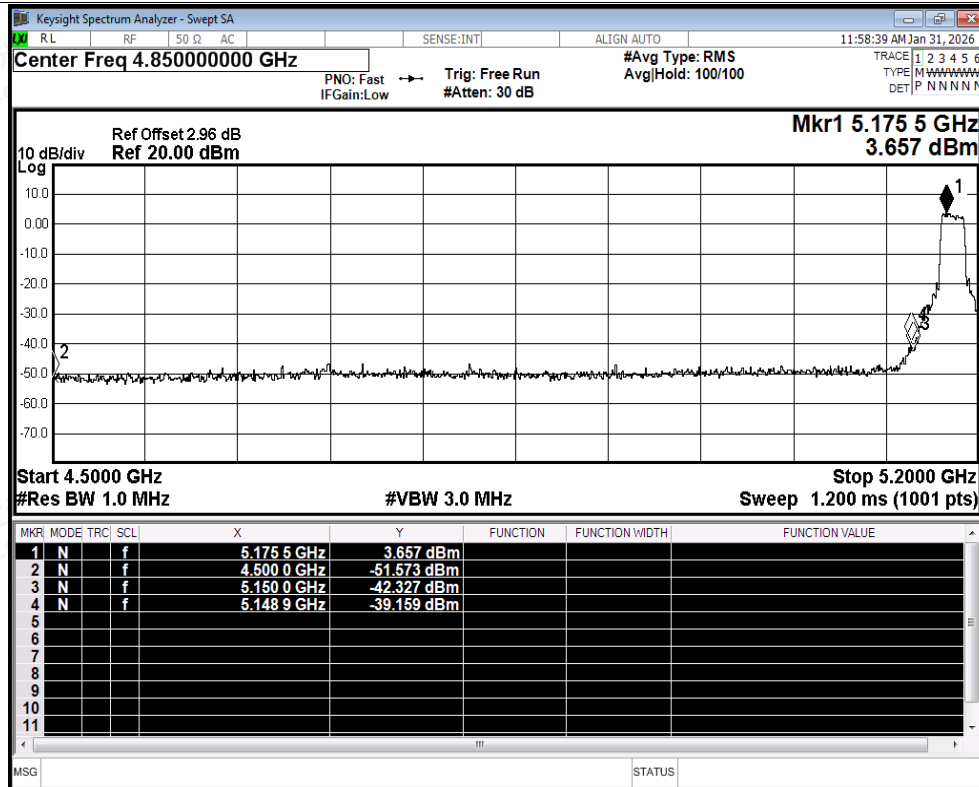

Restrict Band NVNT ax20 5180MHz Ant2 Peak

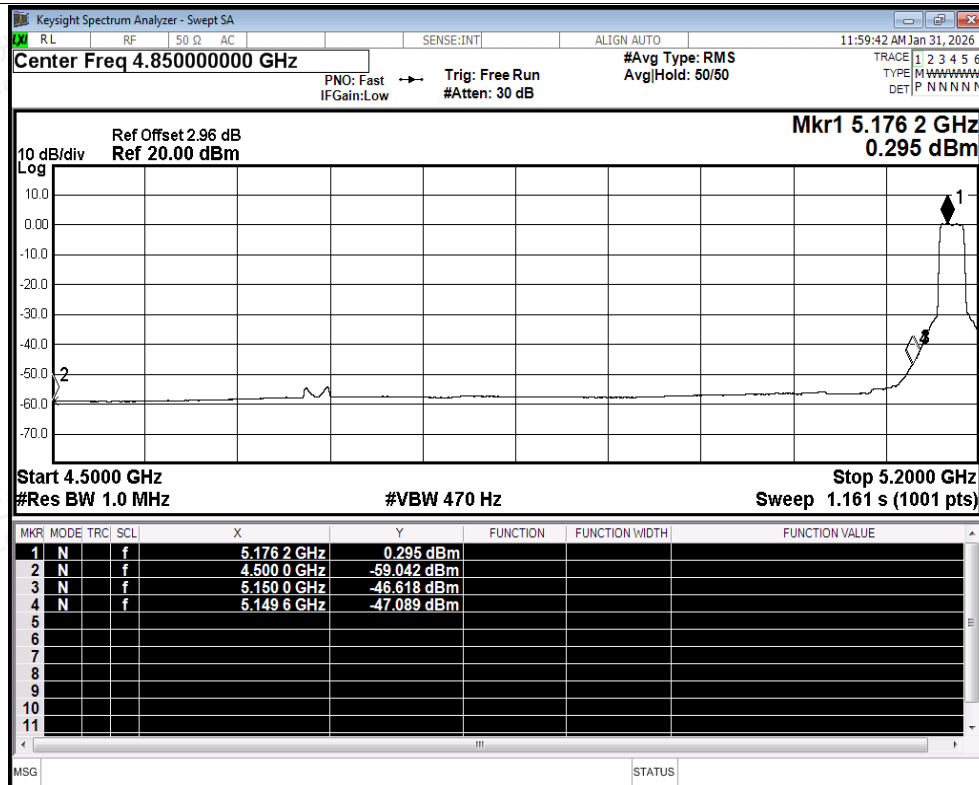

Restrict Band NVNT ax20 5180MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

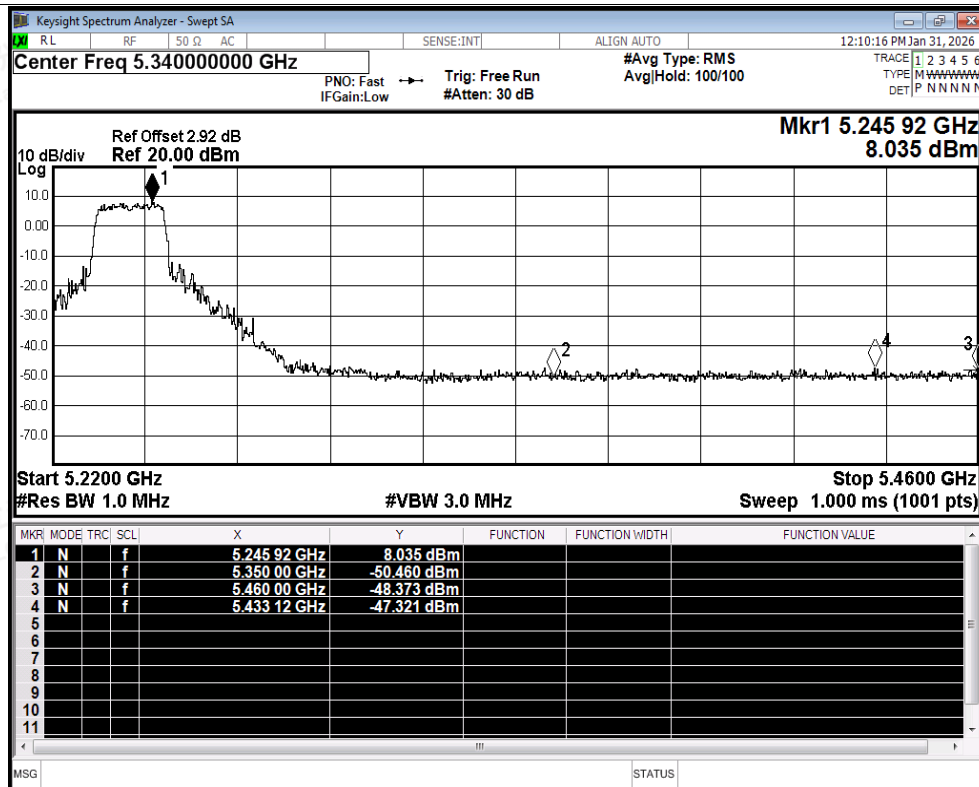

Restrict Band NVNT ax20 5240MHz Ant2 Peak

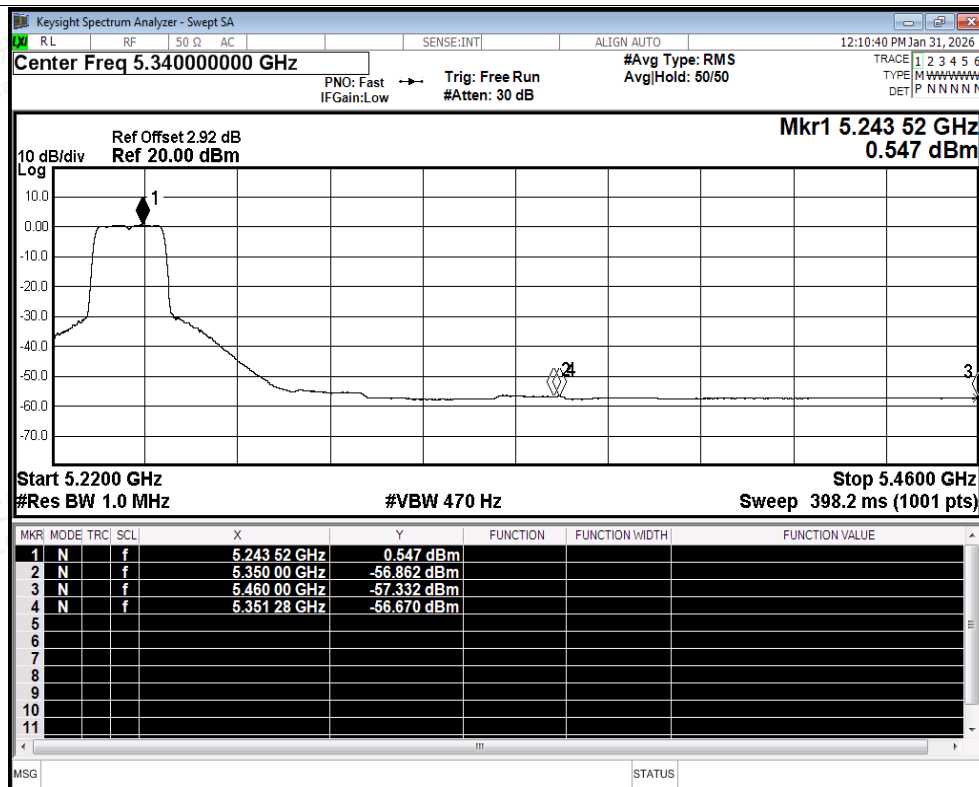

Restrict Band NVNT ax20 5240MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

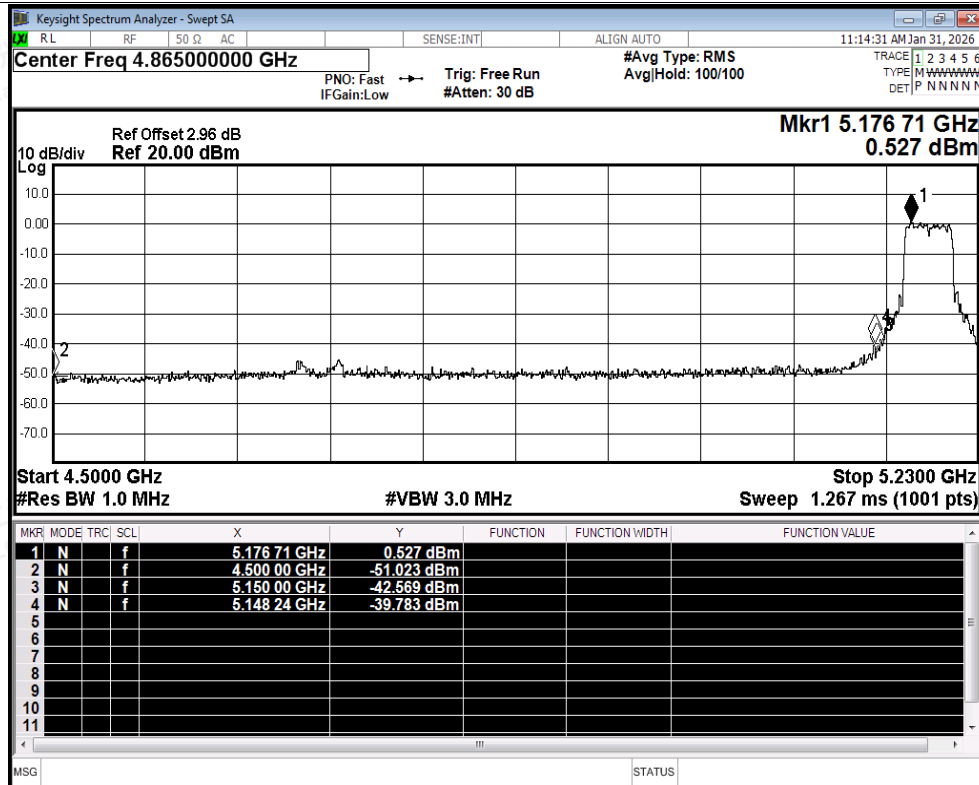

Restrict Band NVNT ax40 5190MHz Ant2 Peak

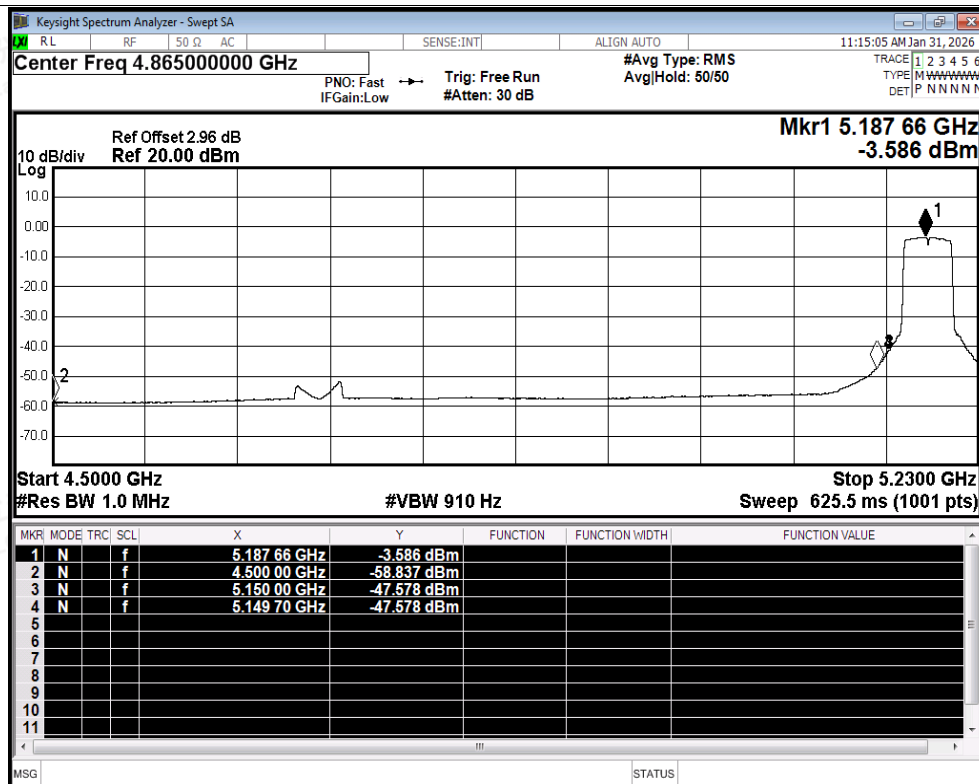

Restrict Band NVNT ax40 5190MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

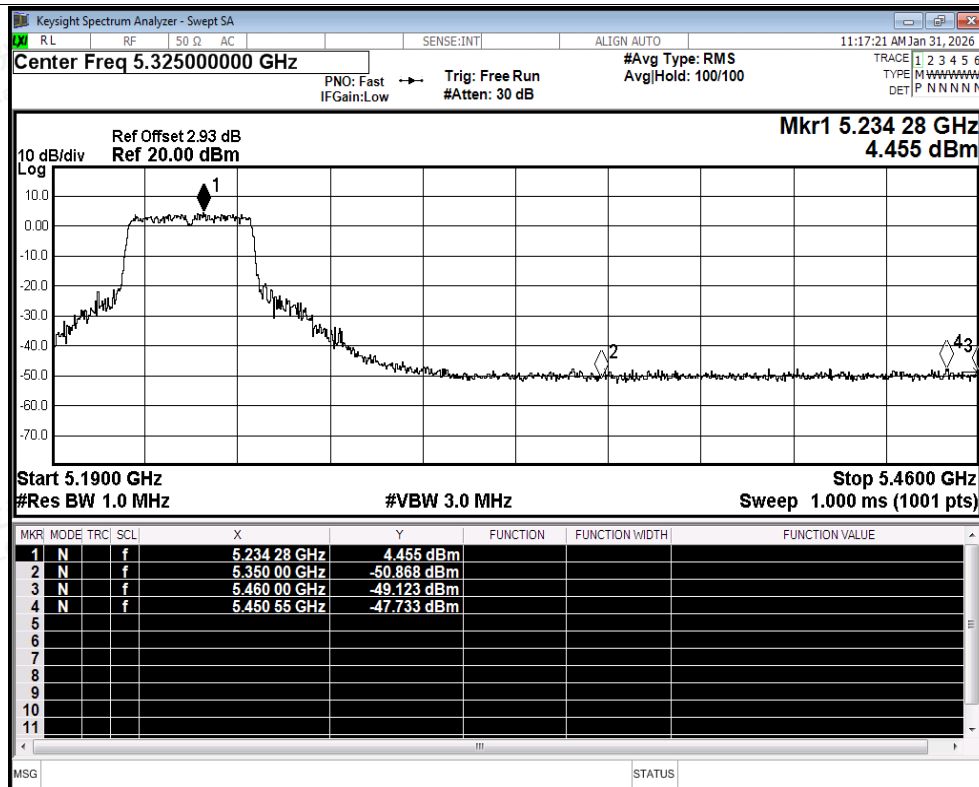

Restrict Band NVNT ax40 5230MHz Ant2 Peak

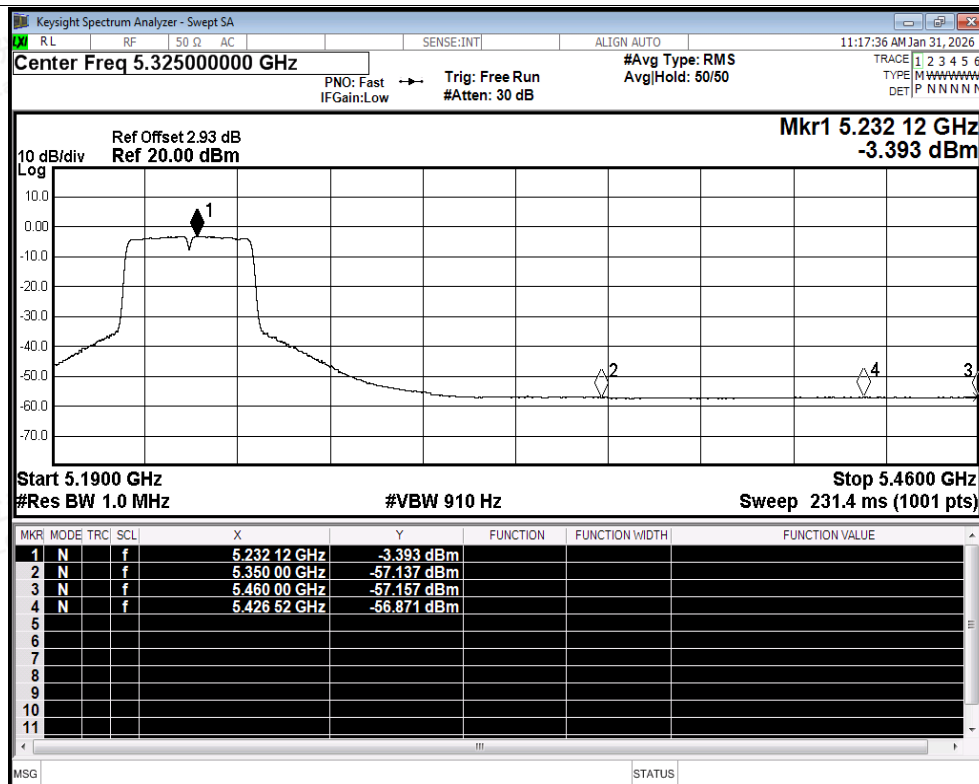

Restrict Band NVNT ax40 5230MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

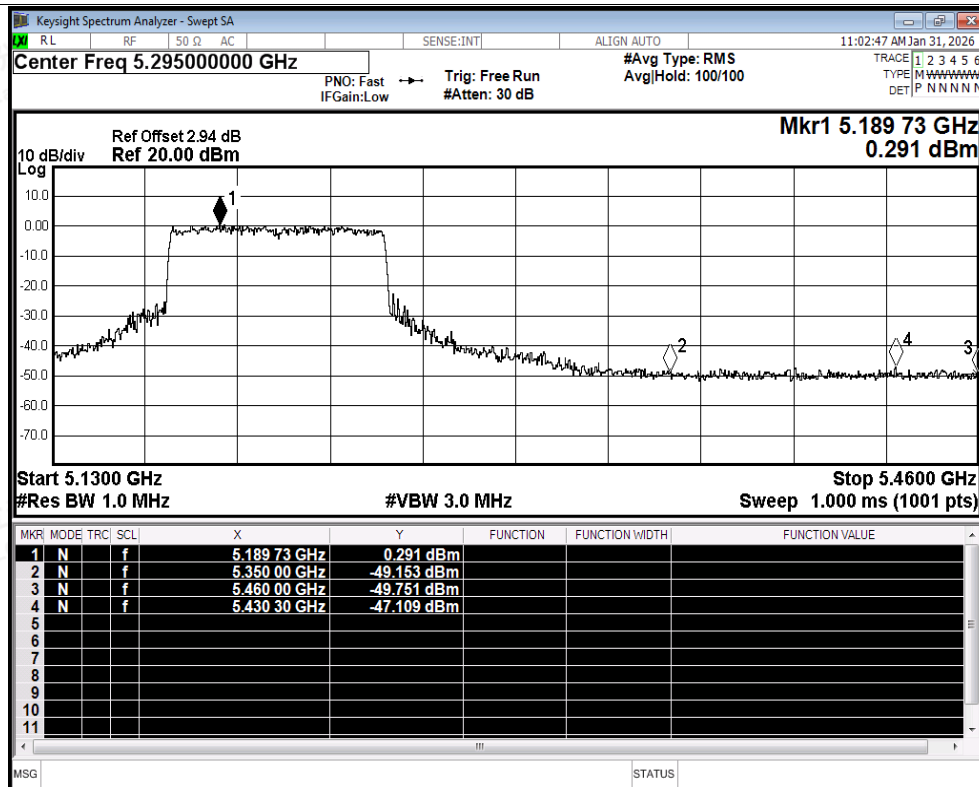

Restrict Band NVNT ax80 5210MHz Ant2 Peak

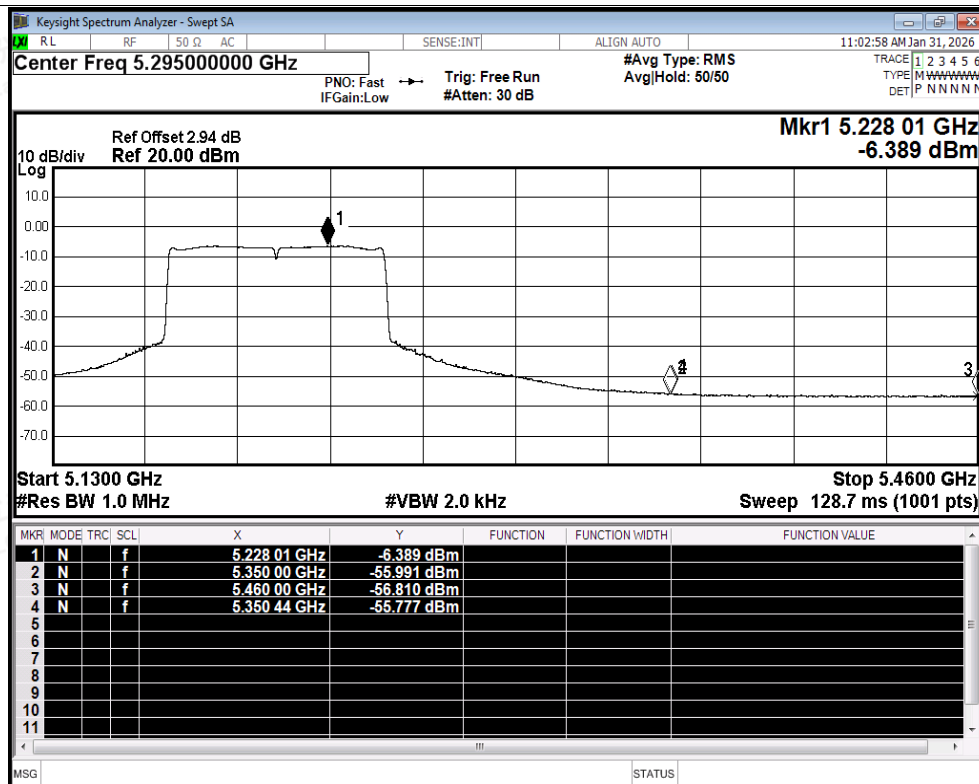

Restrict Band NVNT ax80 5210MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

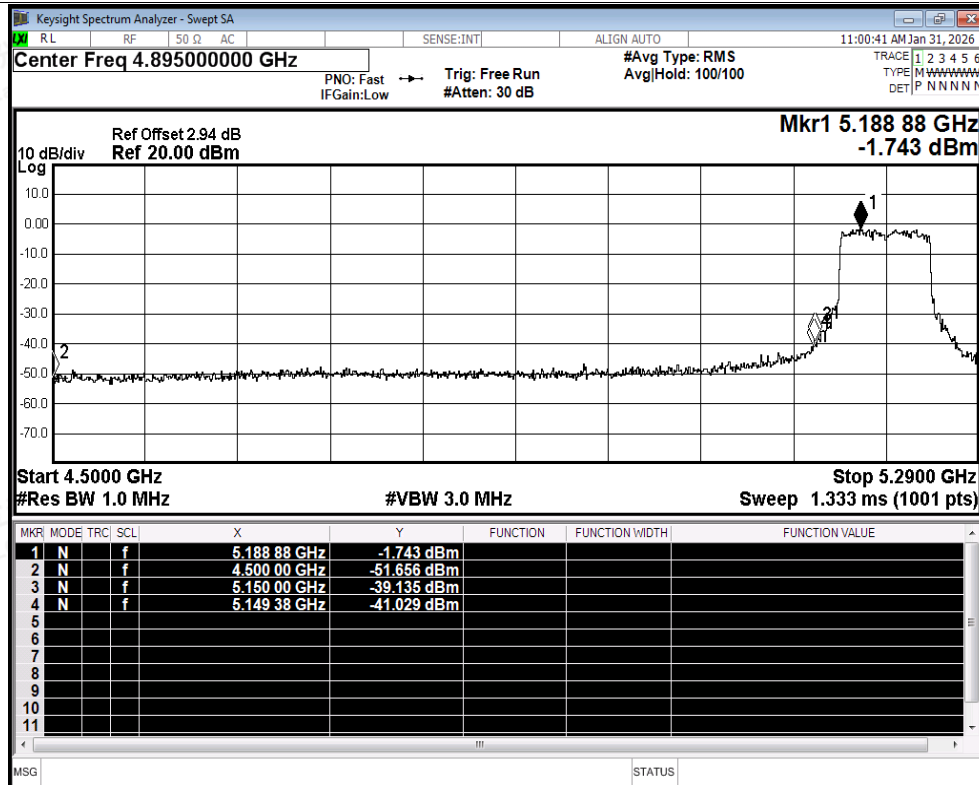

Restrict Band NVNT ax80 5210MHz Ant2 Peak

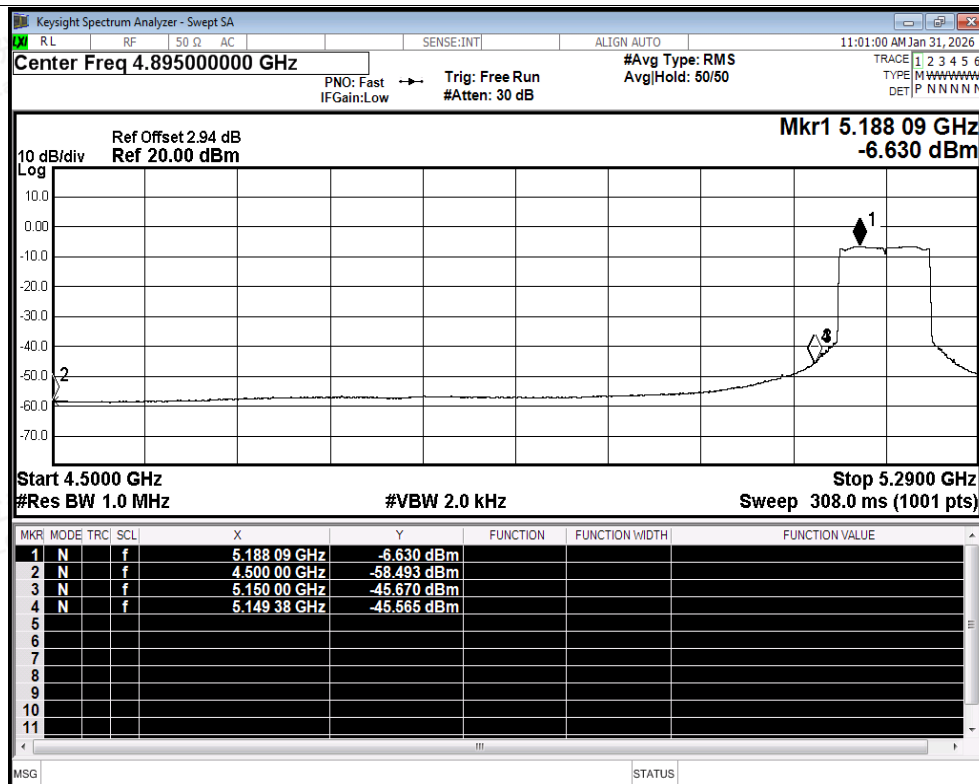

Restrict Band NVNT ax80 5210MHz Ant2 Average



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



MIMO

Condition	Mode	Frequency (MHz)	Ant1 Power (dBm)	Ant2 Power (dBm)	SUM	Gain (dBi)	Total E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	n20	5180	-50.11	-49.69	-46.88	8.59	56.93	Peak	68.2	Pass
NVNT	n20	5180	-58.31	-58.30	-55.29	8.59	48.52	Average	54	Pass
NVNT	n20	5180	-40.88	-42.25	-38.50	8.59	65.32	Peak	68.2	Pass
NVNT	n20	5180	-53.48	-55.28	-51.28	8.59	52.54	Average	54	Pass
NVNT	n20	5180	-38.87	-43.02	-37.46	8.59	66.36	Peak	68.2	Pass
NVNT	n20	5180	-52.91	-55.64	-51.05	8.59	52.76	Average	54	Pass
NVNT	n20	5240	-50.19	-49.58	-46.86	8.59	56.95	Peak	68.2	Pass
NVNT	n20	5240	-58.05	-57.84	-54.93	8.59	48.88	Average	54	Pass
NVNT	n20	5240	-47.14	-46.95	-44.03	8.59	59.78	Peak	68.2	Pass
NVNT	n20	5240	-57.03	-57.39	-54.20	8.59	49.62	Average	54	Pass
NVNT	n20	5240	-51.48	-49.87	-47.59	8.59	56.23	Peak	68.2	Pass
NVNT	n20	5240	-58.06	-58.08	-55.06	8.59	48.76	Average	54	Pass
NVNT	n40	5190	-51.79	-50.76	-48.23	8.59	55.58	Peak	68.2	Pass
NVNT	n40	5190	-58.36	-58.99	-55.65	8.59	48.16	Average	54	Pass
NVNT	n40	5190	-41.25	-40.75	-37.98	8.59	65.84	Peak	68.2	Pass
NVNT	n40	5190	-54.23	-53.50	-50.84	8.59	52.98	Average	54	Pass
NVNT	n40	5190	-42.95	-41.28	-39.02	8.59	64.79	Peak	68.2	Pass
NVNT	n40	5190	-53.97	-53.52	-50.73	8.59	53.09	Average	54	Pass
NVNT	n40	5230	-49.66	-49.43	-46.53	8.59	57.28	Peak	68.2	Pass
NVNT	n40	5230	-57.37	-58.72	-54.98	8.59	48.84	Average	54	Pass
NVNT	n40	5230	-45.65	-46.44	-43.02	8.59	60.80	Peak	68.2	Pass
NVNT	n40	5230	-56.99	-56.91	-53.94	8.59	49.88	Average	54	Pass
NVNT	n40	5230	-50.88	-49.40	-47.07	8.59	56.75	Peak	68.2	Pass
NVNT	n40	5230	-57.65	-58.10	-54.86	8.59	48.96	Average	54	Pass
NVNT	ac20	5180	-50.44	-49.18	-46.75	8.59	57.06	Peak	68.2	Pass
NVNT	ac20	5180	-59.50	-58.62	-56.03	8.59	47.79	Average	54	Pass
NVNT	ac20	5180	-39.22	-43.28	-37.78	8.59	66.04	Peak	68.2	Pass
NVNT	ac20	5180	-52.81	-54.99	-50.75	8.59	53.06	Average	54	Pass
NVNT	ac20	5180	-42.59	-42.94	-39.75	8.59	64.07	Peak	68.2	Pass
NVNT	ac20	5180	-55.29	-53.27	-51.15	8.59	52.66	Average	54	Pass
NVNT	ac20	5240	-49.96	-50.26	-47.10	8.59	56.72	Peak	68.2	Pass
NVNT	ac20	5240	-58.42	-57.91	-55.15	8.59	48.67	Average	54	Pass
NVNT	ac20	5240	-46.76	-46.98	-43.86	8.59	59.96	Peak	68.2	Pass
NVNT	ac20	5240	-57.22	-57.19	-54.19	8.59	49.62	Average	54	Pass
NVNT	ac20	5240	-50.95	-49.48	-47.14	8.59	56.67	Peak	68.2	Pass
NVNT	ac20	5240	-57.77	-58.68	-55.19	8.59	48.63	Average	54	Pass
NVNT	ac40	5190	-51.27	-49.41	-47.23	8.59	56.59	Peak	68.2	Pass
NVNT	ac40	5190	-58.47	-58.35	-55.40	8.59	48.42	Average	54	Pass
NVNT	ac40	5190	-42.01	-39.22	-37.38	8.59	66.43	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac40	5190	-53.01	-55.22	-50.97	8.59	52.85	Average	54	Pass
NVNT	ac40	5190	-41.86	-43.92	-39.76	8.59	64.06	Peak	68.2	Pass
NVNT	ac40	5190	-53.14	-56.39	-51.46	8.59	52.36	Average	54	Pass
NVNT	ac40	5230	-50.58	-49.57	-47.04	8.59	56.78	Peak	68.2	Pass
NVNT	ac40	5230	-57.91	-57.75	-54.82	8.59	49.00	Average	54	Pass
NVNT	ac40	5230	-47.07	-46.88	-43.96	8.59	59.85	Peak	68.2	Pass
NVNT	ac40	5230	-57.28	-57.20	-54.23	8.59	49.59	Average	54	Pass
NVNT	ac40	5230	-48.37	-49.85	-46.04	8.59	57.78	Peak	68.2	Pass
NVNT	ac40	5230	-58.21	-58.01	-55.10	8.59	48.72	Average	54	Pass
NVNT	ac80	5210	-47.68	-48.82	-45.20	8.59	58.62	Peak	68.2	Pass
NVNT	ac80	5210	-57.54	-57.67	-54.59	8.59	49.22	Average	54	Pass
NVNT	ac80	5210	-46.71	-46.37	-43.53	8.59	60.29	Peak	68.2	Pass
NVNT	ac80	5210	-56.99	-56.69	-53.83	8.59	49.99	Average	54	Pass
NVNT	ac80	5210	-49.08	-50.33	-46.65	8.59	57.17	Peak	68.2	Pass
NVNT	ac80	5210	-57.20	-57.75	-54.46	8.59	49.36	Average	54	Pass
NVNT	ac80	5210	-50.40	-49.85	-47.11	8.59	56.71	Peak	68.2	Pass
NVNT	ac80	5210	-58.26	-58.58	-55.41	8.59	48.41	Average	54	Pass
NVNT	ac80	5210	-40.39	-42.42	-38.28	8.59	65.54	Peak	68.2	Pass
NVNT	ac80	5210	-53.12	-55.32	-51.07	8.59	52.75	Average	54	Pass
NVNT	ac80	5210	-40.24	-42.40	-38.18	8.59	65.64	Peak	68.2	Pass
NVNT	ac80	5210	-52.93	-55.10	-50.87	8.59	52.95	Average	54	Pass
NVNT	ax20	5180	-50.65	-50.68	-47.65	8.59	56.16	Peak	68.2	Pass
NVNT	ax20	5180	-58.62	-58.44	-55.52	8.59	48.30	Average	54	Pass
NVNT	ax20	5180	-42.17	-43.73	-39.87	8.59	63.95	Peak	68.2	Pass
NVNT	ax20	5180	-53.11	-54.82	-50.87	8.59	52.95	Average	54	Pass
NVNT	ax20	5180	-41.88	-41.56	-38.71	8.59	65.11	Peak	68.2	Pass
NVNT	ax20	5180	-52.59	-54.52	-50.44	8.59	53.38	Average	54	Pass
NVNT	ax20	5240	-48.91	-49.57	-46.22	8.59	57.60	Peak	68.2	Pass
NVNT	ax20	5240	-57.94	-58.16	-55.04	8.59	48.78	Average	54	Pass
NVNT	ax20	5240	-47.13	-46.79	-43.95	8.59	59.87	Peak	68.2	Pass
NVNT	ax20	5240	-57.22	-57.00	-54.10	8.59	49.72	Average	54	Pass
NVNT	ax20	5240	-50.57	-51.05	-47.79	8.59	56.02	Peak	68.2	Pass
NVNT	ax20	5240	-57.47	-58.34	-54.87	8.59	48.94	Average	54	Pass
NVNT	ax40	5190	-51.37	-49.36	-47.24	8.59	56.58	Peak	68.2	Pass
NVNT	ax40	5190	-57.99	-58.00	-54.98	8.59	48.83	Average	54	Pass
NVNT	ax40	5190	-39.39	-44.38	-38.19	8.59	65.62	Peak	68.2	Pass
NVNT	ax40	5190	-53.17	-55.05	-51.00	8.59	52.82	Average	54	Pass
NVNT	ax40	5190	-43.58	-45.35	-41.37	8.59	62.45	Peak	68.2	Pass
NVNT	ax40	5190	-53.25	-56.27	-51.49	8.59	52.33	Average	54	Pass
NVNT	ax40	5230	-48.11	-50.87	-46.26	8.59	57.55	Peak	68.2	Pass
NVNT	ax40	5230	-57.41	-58.30	-54.82	8.59	49.00	Average	54	Pass
NVNT	ax40	5230	-46.82	-47.39	-44.09	8.59	59.73	Peak	68.2	Pass
NVNT	ax40	5230	-57.24	-57.28	-54.25	8.59	49.57	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax40	5230	-49.32	-48.80	-46.04	8.59	57.78	Peak	68.2	Pass
NVNT	ax40	5230	-57.92	-58.90	-55.37	8.59	48.45	Average	54	Pass
NVNT	ax80	5210	-50.27	-47.73	-45.81	8.59	58.01	Peak	68.2	Pass
NVNT	ax80	5210	-57.27	-58.07	-54.64	8.59	49.18	Average	54	Pass
NVNT	ax80	5210	-46.66	-46.80	-43.72	8.59	60.10	Peak	68.2	Pass
NVNT	ax80	5210	-56.65	-56.72	-53.67	8.59	50.14	Average	54	Pass
NVNT	ax80	5210	-49.64	-49.22	-46.41	8.59	57.40	Peak	68.2	Pass
NVNT	ax80	5210	-57.80	-57.55	-54.66	8.59	49.15	Average	54	Pass
NVNT	ax80	5210	-49.28	-50.68	-46.91	8.59	56.90	Peak	68.2	Pass
NVNT	ax80	5210	-58.87	-58.33	-55.58	8.59	48.24	Average	54	Pass
NVNT	ax80	5210	-42.12	-41.36	-38.71	8.59	65.10	Peak	68.2	Pass
NVNT	ax80	5210	-53.42	-54.84	-51.06	8.59	52.76	Average	54	Pass
NVNT	ax80	5210	-41.35	-39.48	-37.30	8.59	66.51	Peak	68.2	Pass
NVNT	ax80	5210	-55.08	-53.16	-51.00	8.59	52.81	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity




D.5 Frequency Stability

Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5180	Ant1	5180	0	0	25	Pass
NVNT	a	5200	Ant1	5199.98	-20000	-3.85	25	Pass
NVNT	a	5240	Ant1	5239.98	-20000	-3.82	25	Pass
NVNT	n20	5180	Ant1	5179.98	-20000	-3.86	25	Pass
NVNT	n20	5200	Ant1	5199.98	-20000	-3.85	25	Pass
NVNT	n20	5240	Ant1	5240	0	0	25	Pass
NVNT	n40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
NVNT	n40	5230	Ant1	5230	0	0	25	Pass
NVNT	ac20	5180	Ant1	5180	0	0	25	Pass
NVNT	ac20	5200	Ant1	5199.98	-20000	-3.85	25	Pass
NVNT	ac20	5240	Ant1	5239.98	-20000	-3.82	25	Pass
NVNT	ac40	5190	Ant1	5190	0	0	25	Pass
NVNT	ac40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
NVNT	ac80	5210	Ant1	5210	0	0	25	Pass
NVNT	ax20	5180	Ant1	5179.98	-20000	-3.86	25	Pass
NVNT	ax20	5200	Ant1	5199.98	-20000	-3.85	25	Pass
NVNT	ax20	5240	Ant1	5240	0	0	25	Pass
NVNT	ax40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
NVNT	ax40	5230	Ant1	5230	0	0	25	Pass
NVNT	ax80	5210	Ant1	5210	0	0	25	Pass



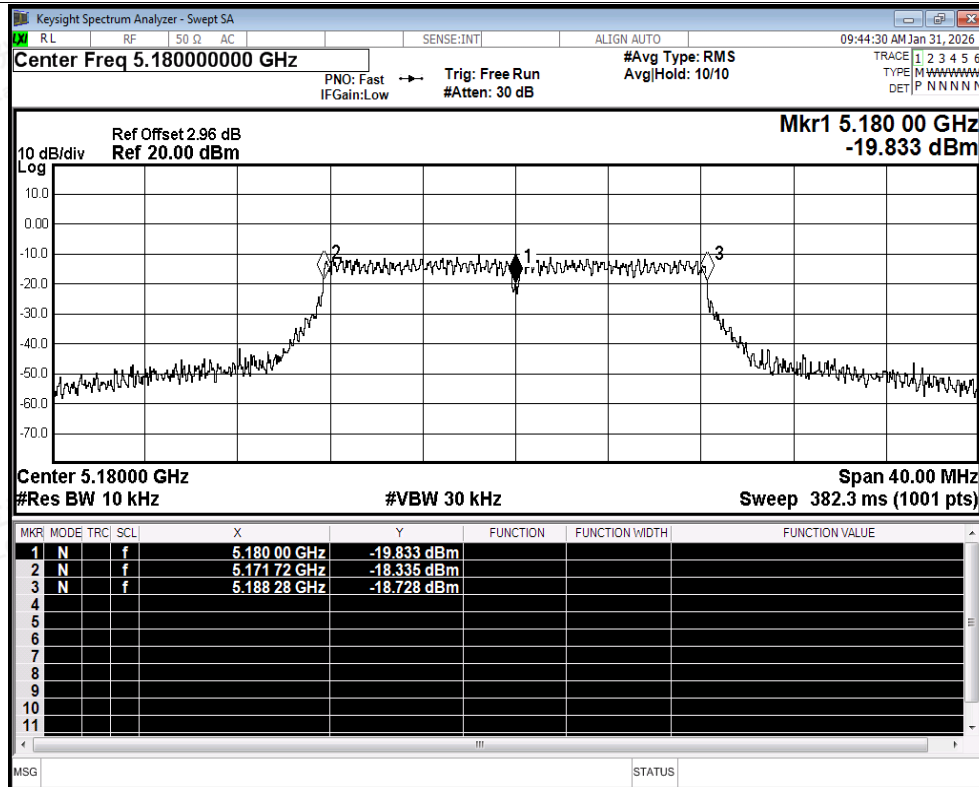

Freq. Stability NVNT a 5180MHz Ant1

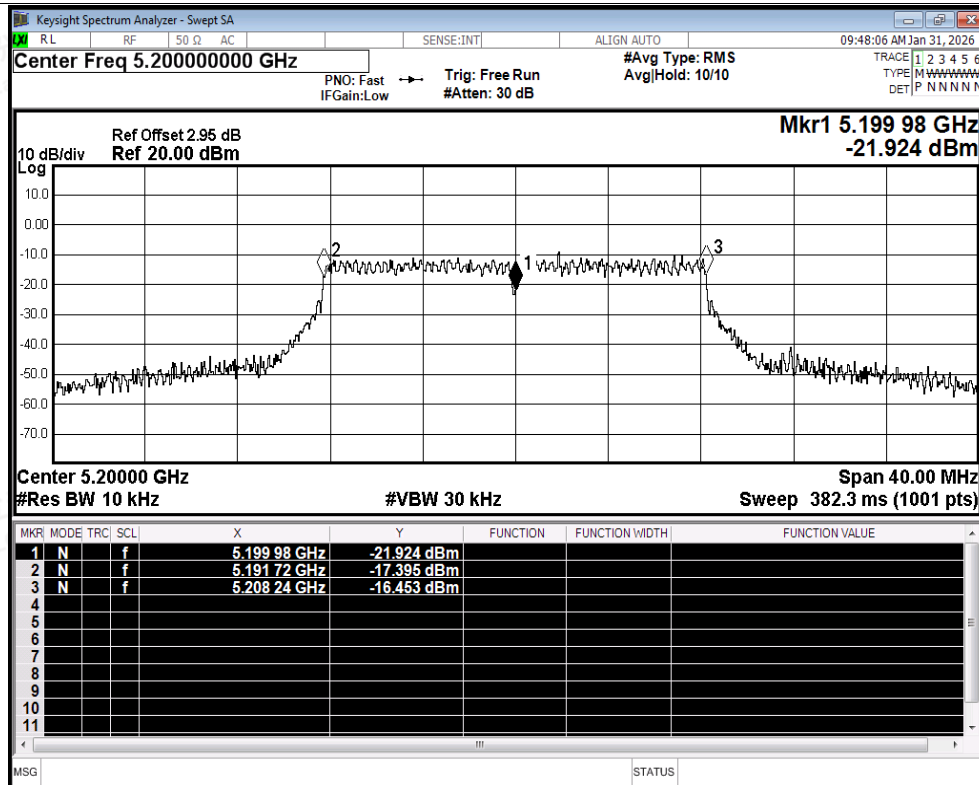

Freq. Stability NVNT a 5200MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

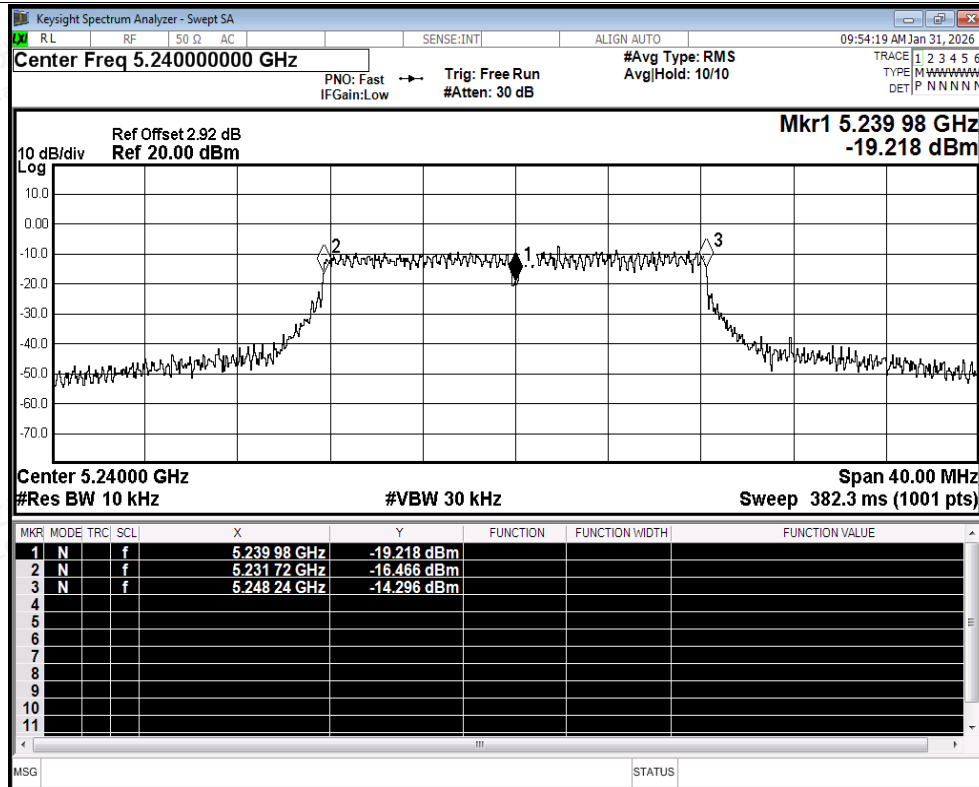

Freq. Stability NVNT a 5240MHz Ant1

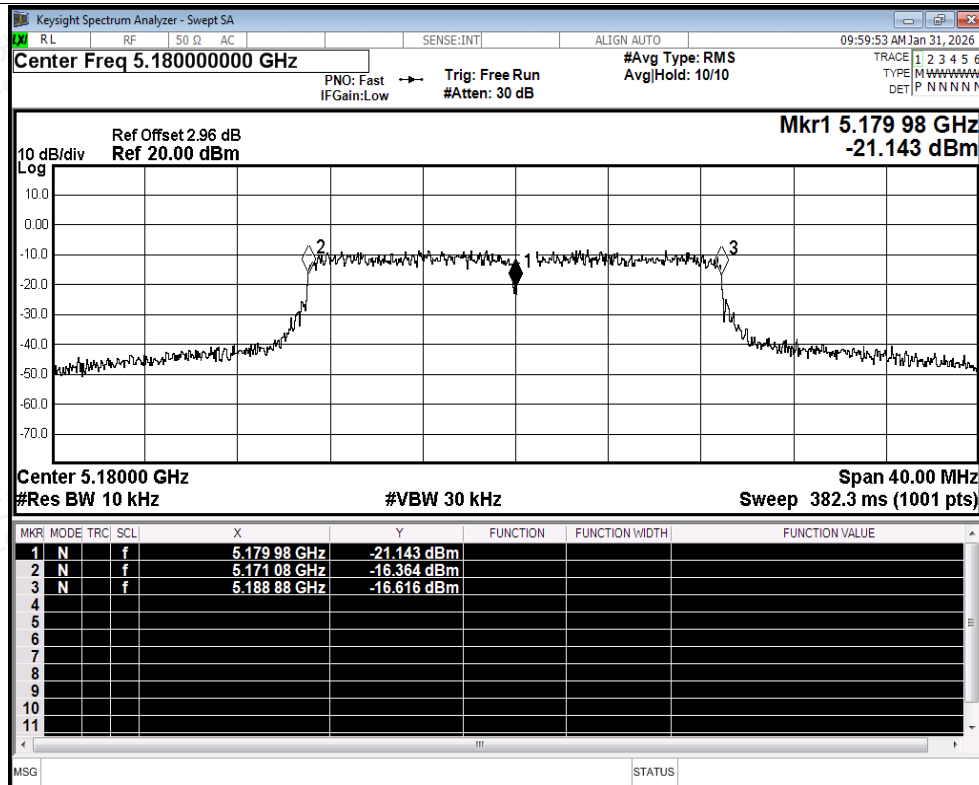

Freq. Stability NVNT n20 5180MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

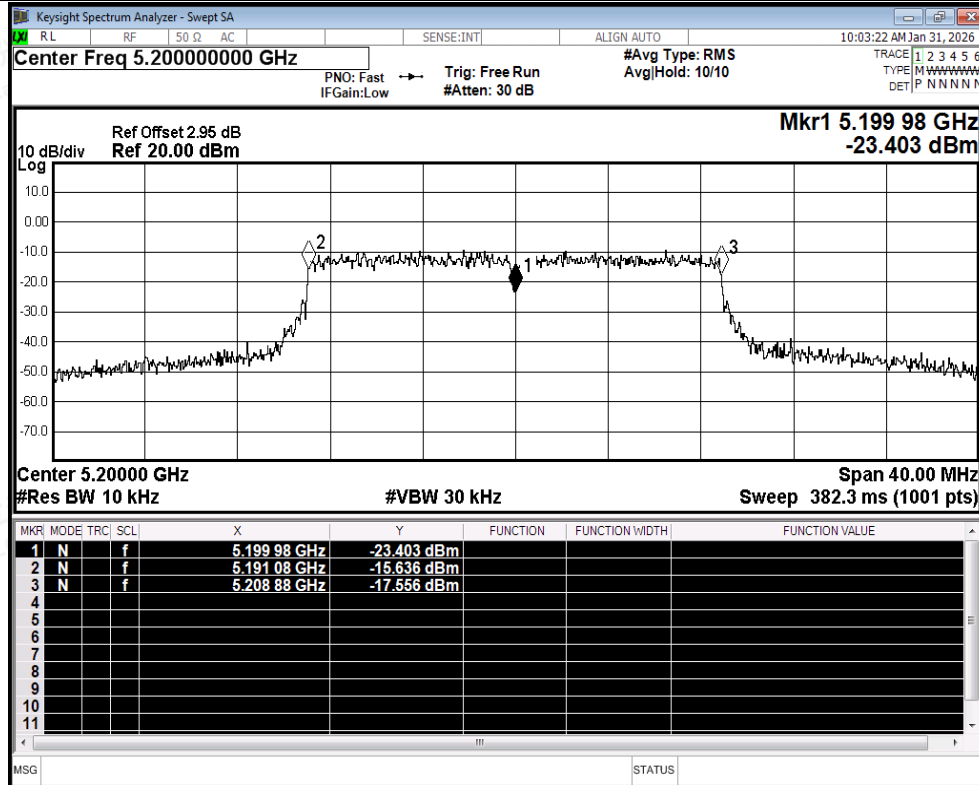

Freq. Stability NVNT n20 5200MHz Ant1

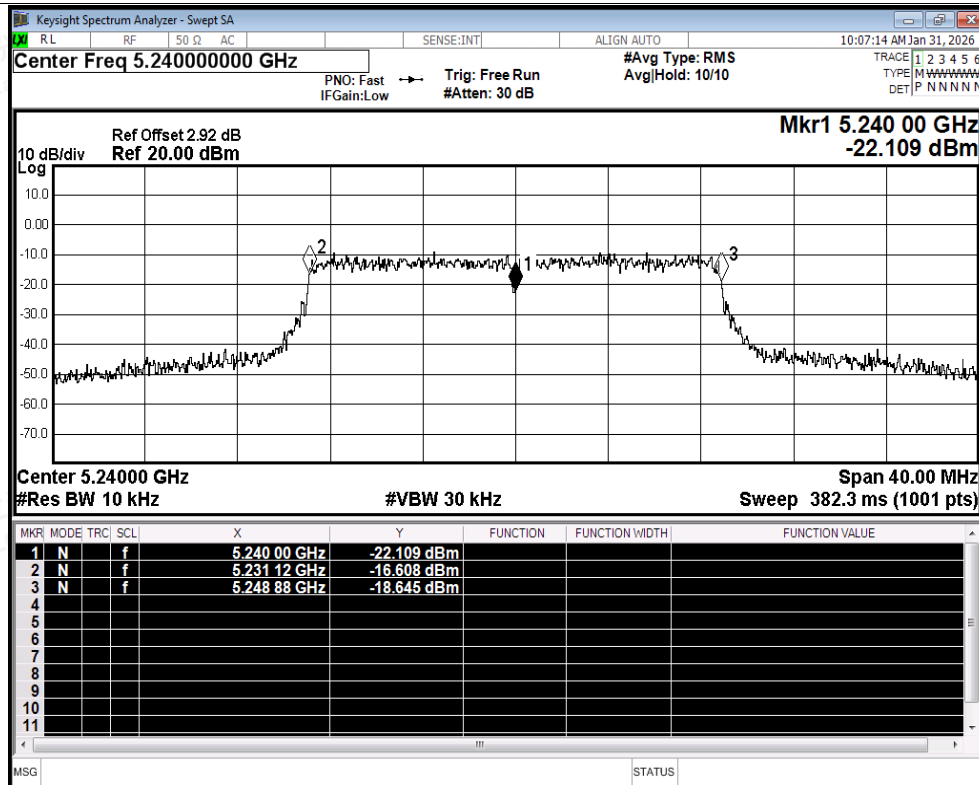

Freq. Stability NVNT n20 5240MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

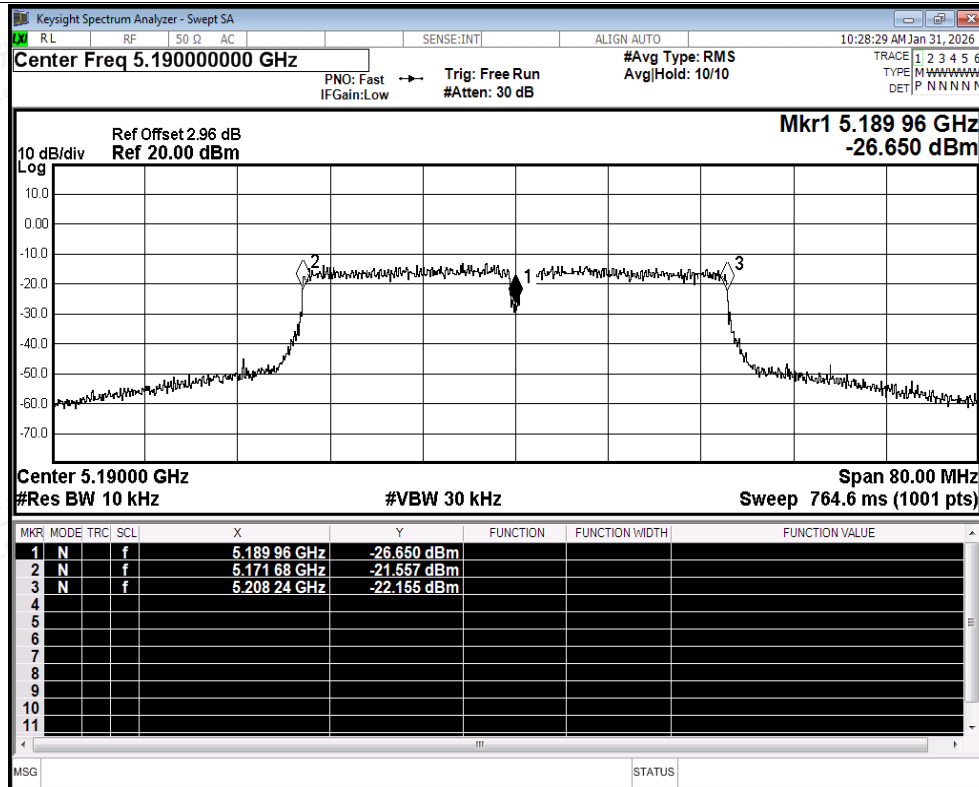

Freq. Stability NVNT n40 5190MHz Ant1

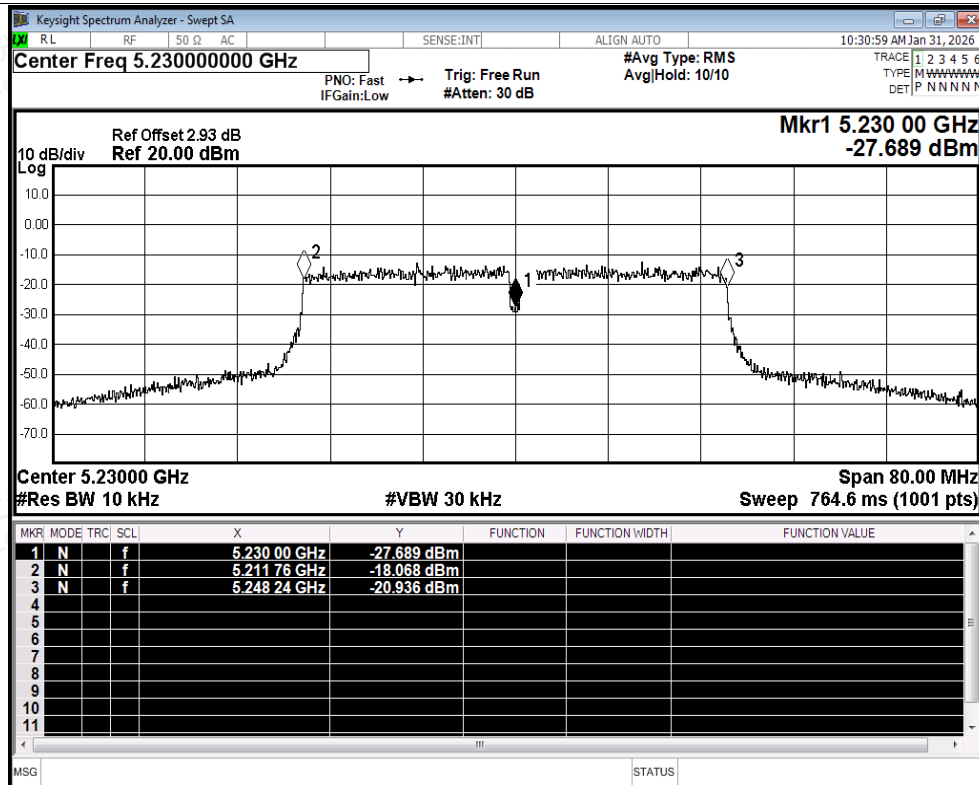

Freq. Stability NVNT n40 5230MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

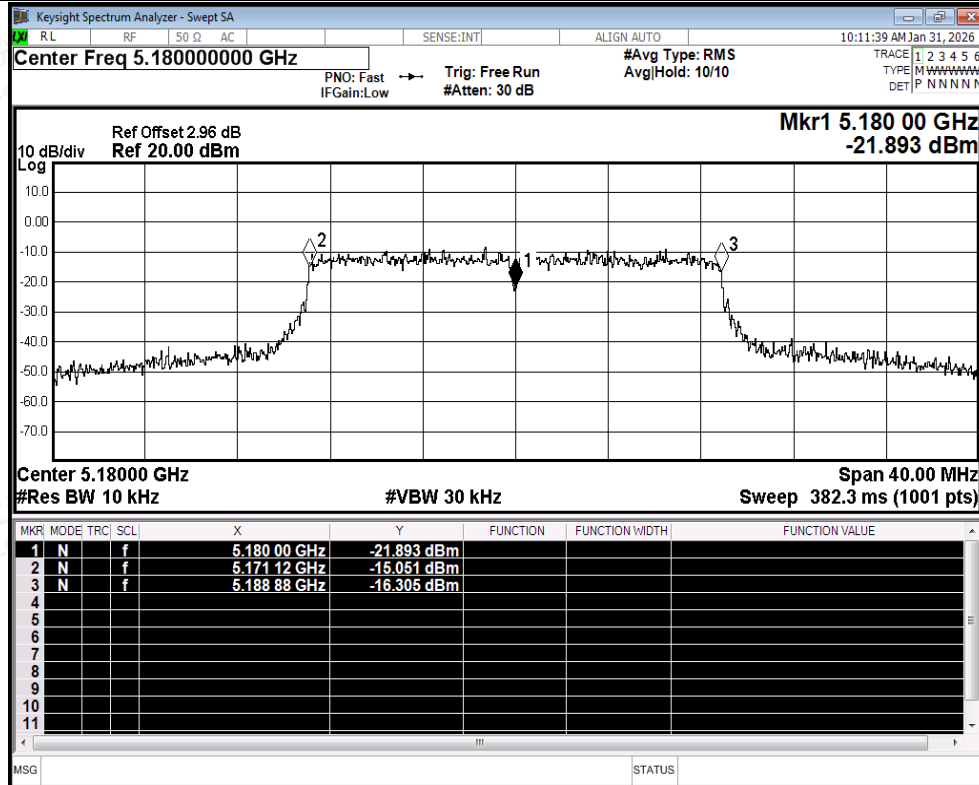

Freq. Stability NVNT ac20 5180MHz Ant1

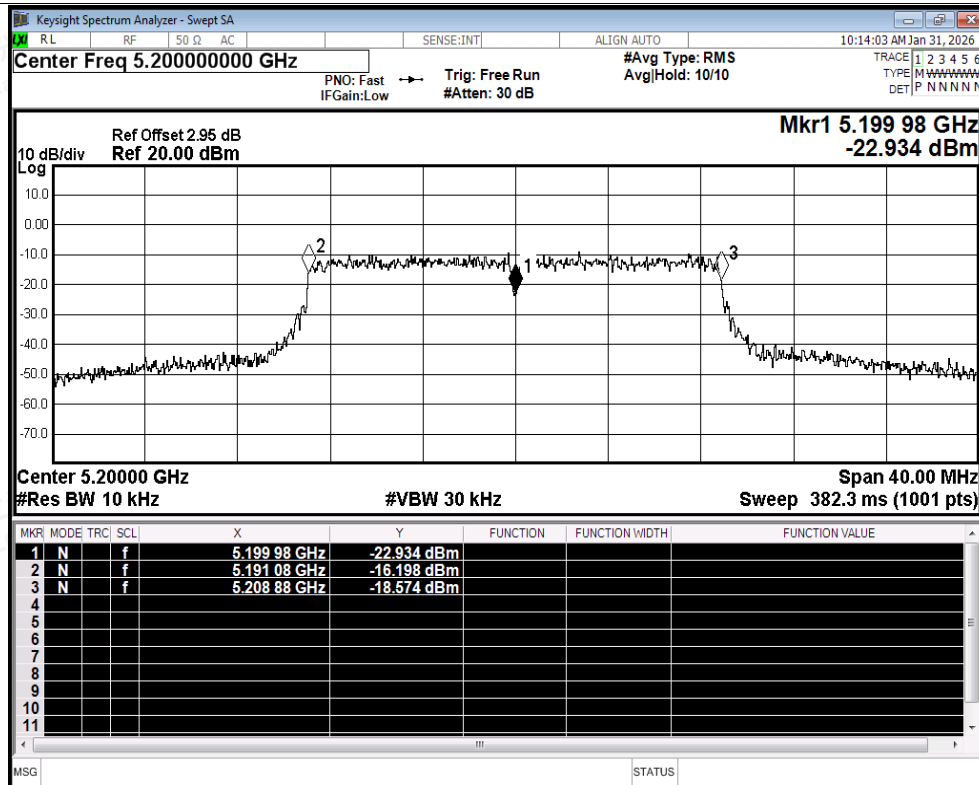

Freq. Stability NVNT ac20 5200MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

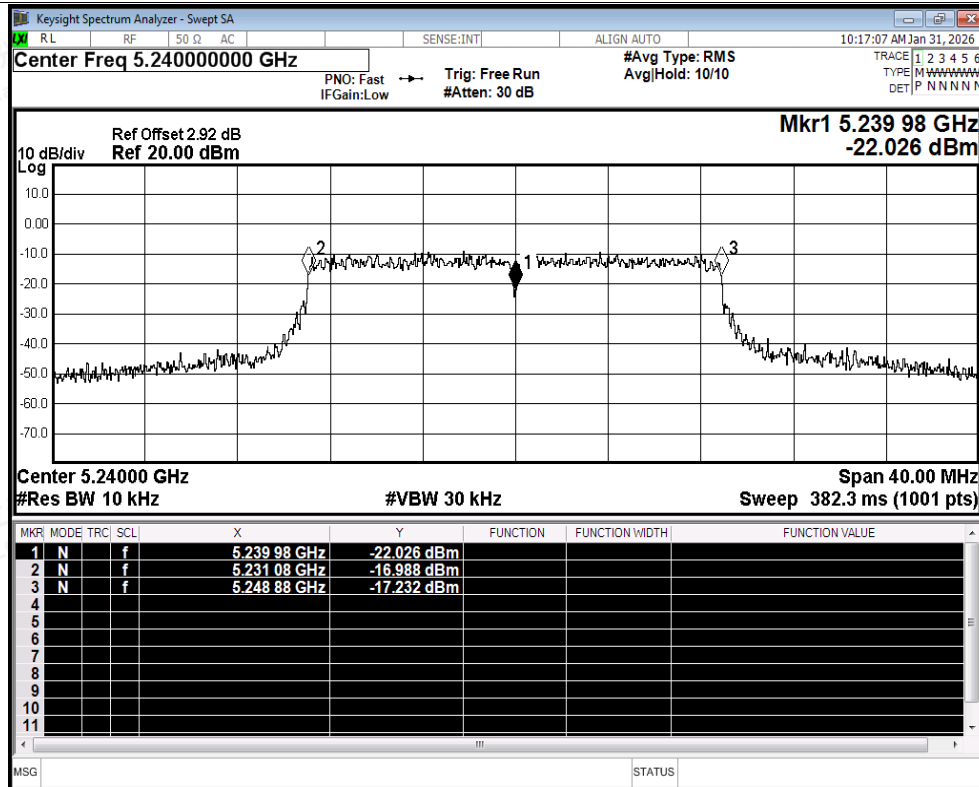

Freq. Stability NVNT ac20 5240MHz Ant1

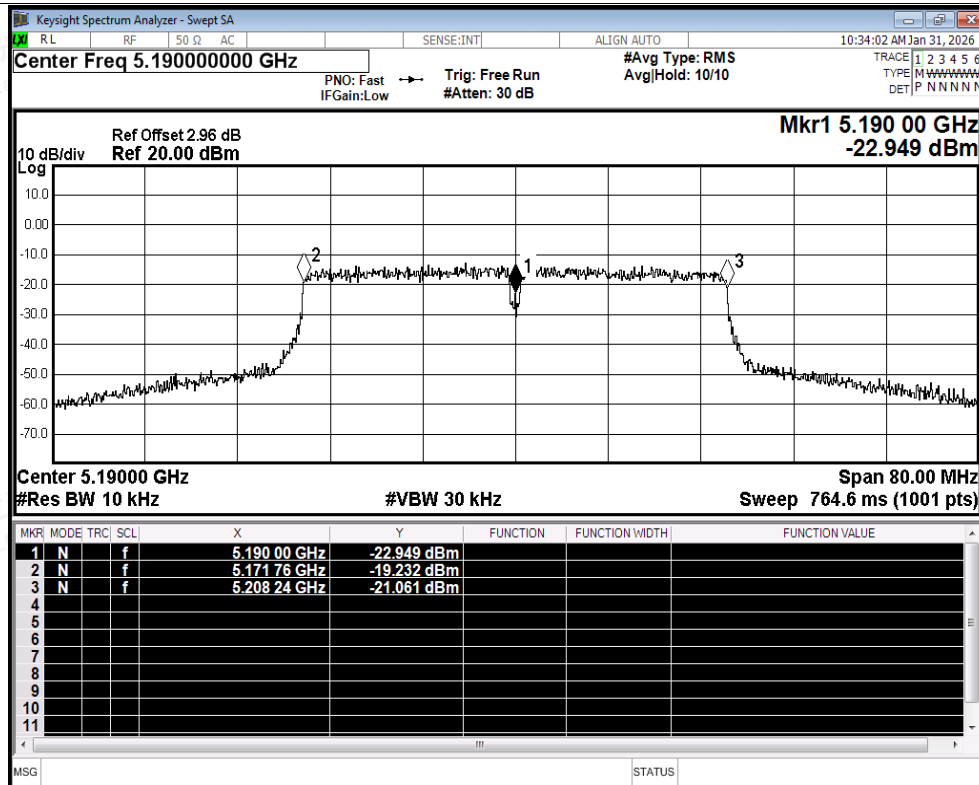

Freq. Stability NVNT ac40 5190MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

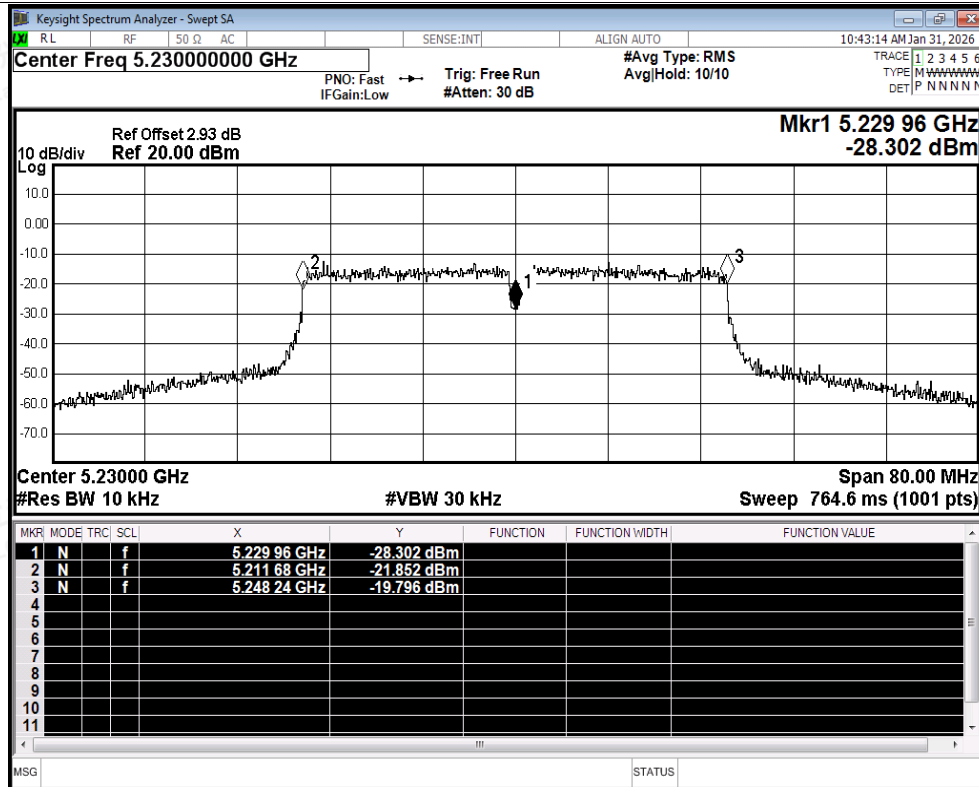

Freq. Stability NVNT ac40 5230MHz Ant1

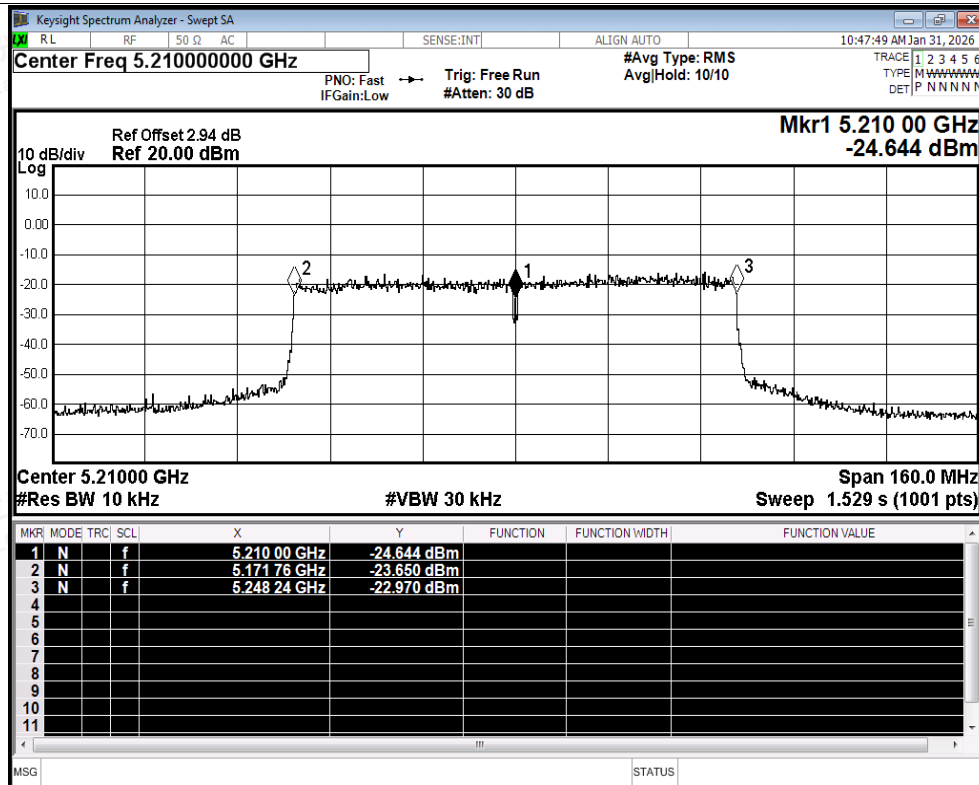

Freq. Stability NVNT ac80 5210MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

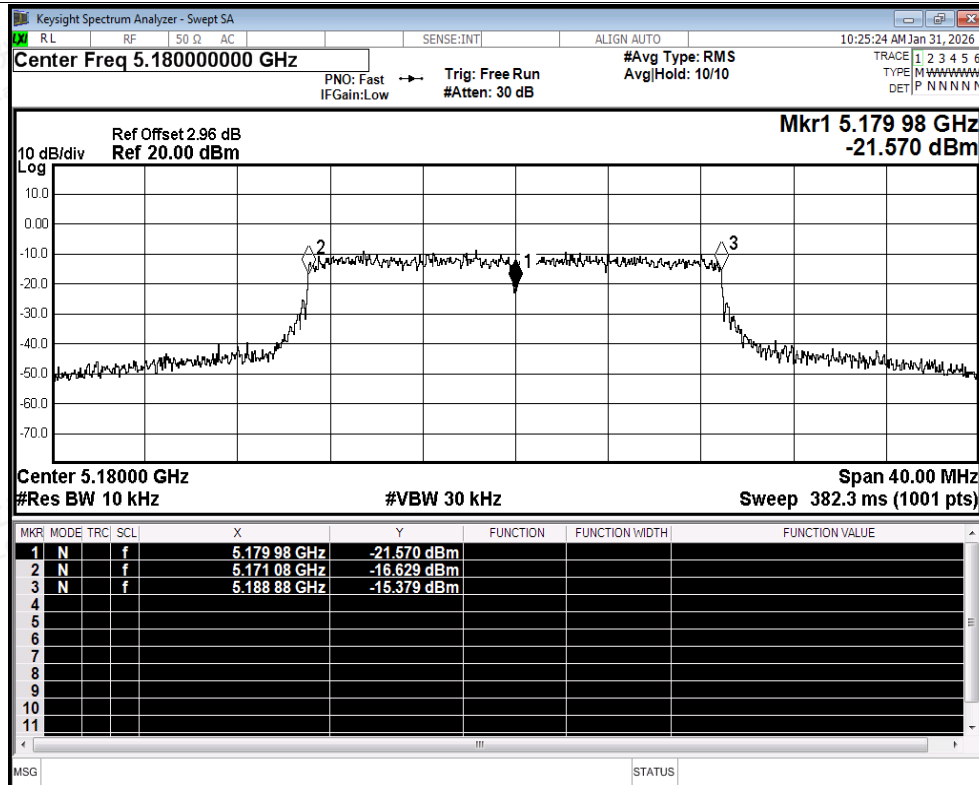


Freq. Stability NVNT ax20 5180MHz Ant1

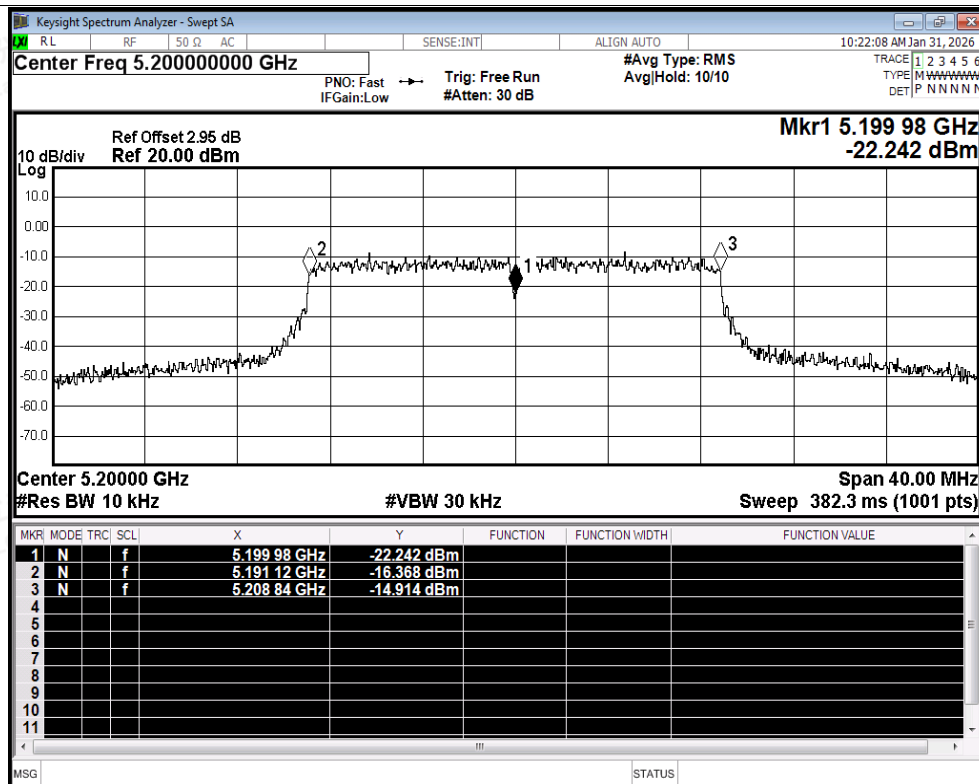


Freq. Stability NVNT ax20 5200MHz Ant1



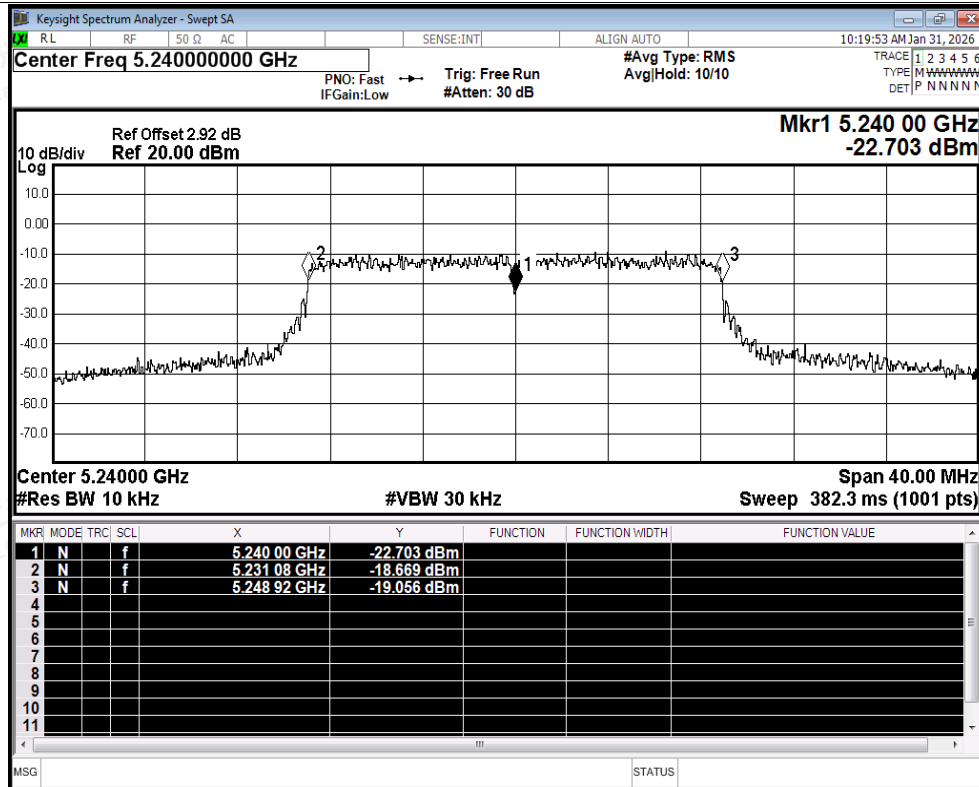

Freq. Stability NVNT ax20 5240MHz Ant1

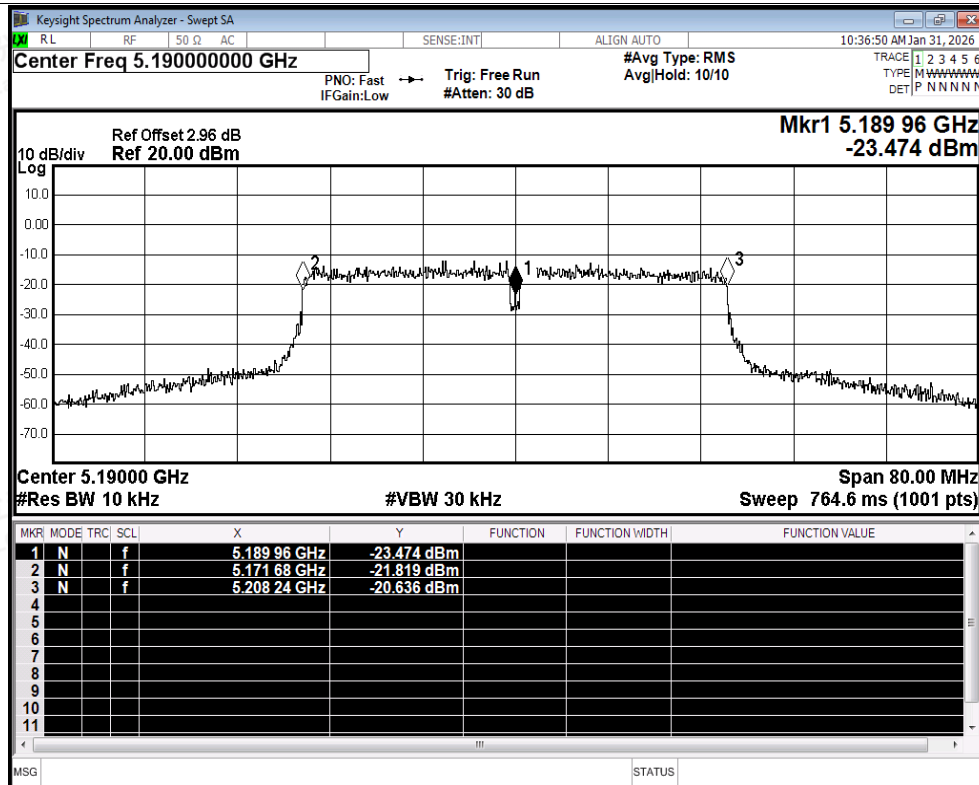

Freq. Stability NVNT ax40 5190MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

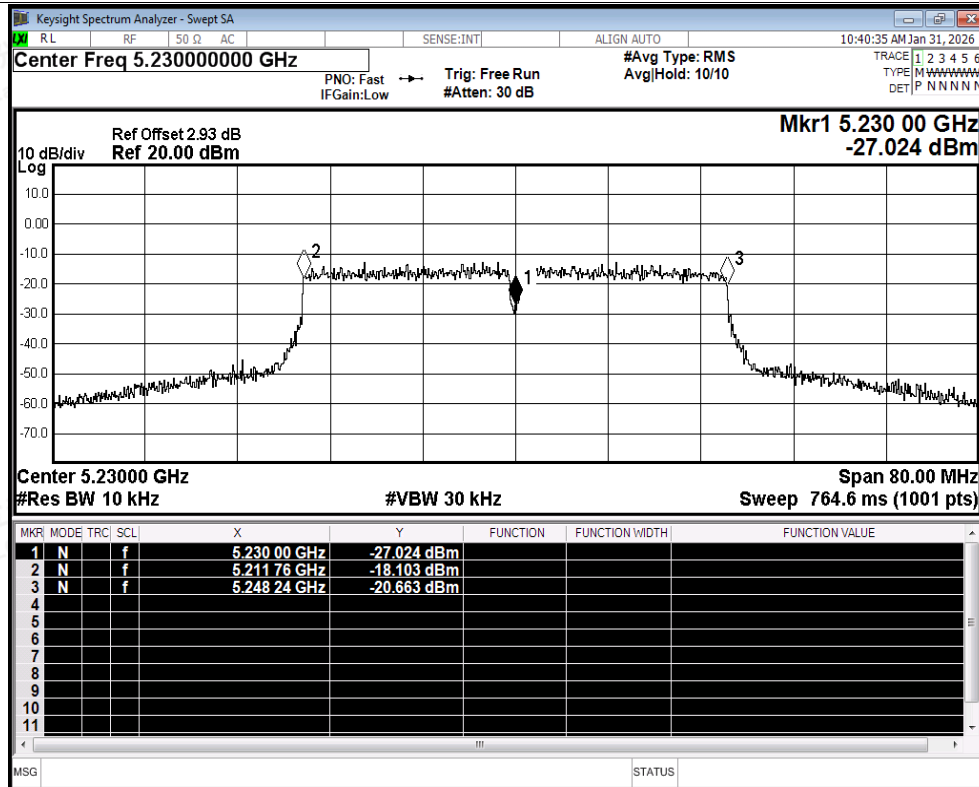

Freq. Stability NVNT ax40 5230MHz Ant1

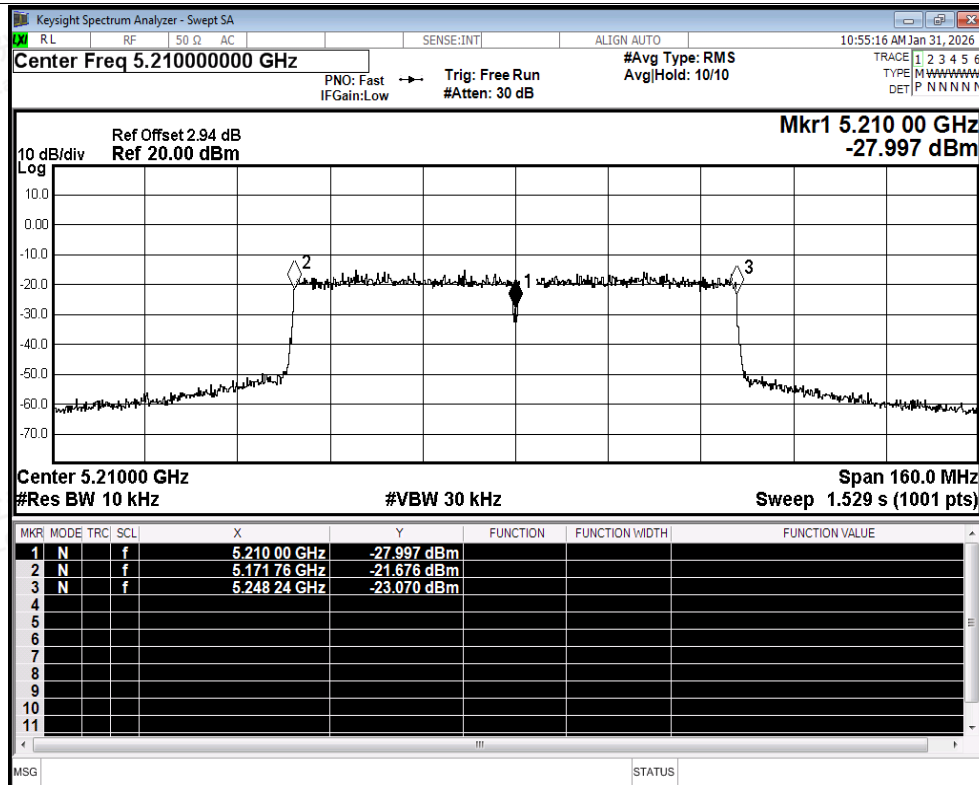

Freq. Stability NVNT ax80 5210MHz Ant1



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5180	Ant2	5179.98	-20000	-3.86	25	Pass
NVNT	a	5200	Ant2	5199.98	-20000	-3.85	25	Pass
NVNT	a	5240	Ant2	5240	0	0	25	Pass
NVNT	n20	5180	Ant2	5179.98	-20000	-3.86	25	Pass
NVNT	n20	5200	Ant2	5199.98	-20000	-3.85	25	Pass
NVNT	n20	5240	Ant2	5240.02	20000	3.82	25	Pass
NVNT	n40	5190	Ant2	5190	0	0	25	Pass
NVNT	n40	5230	Ant2	5230	0	0	25	Pass
NVNT	ac20	5180	Ant2	5180	0	0	25	Pass
NVNT	ac20	5200	Ant2	5199.98	-20000	-3.85	25	Pass
NVNT	ac20	5240	Ant2	5240	0	0	25	Pass
NVNT	ac40	5190	Ant2	5189.96	-40000	-7.71	25	Pass
NVNT	ac40	5230	Ant2	5230	0	0	25	Pass
NVNT	ac80	5210	Ant2	5210	0	0	25	Pass
NVNT	ax20	5180	Ant2	5179.98	-20000	-3.86	25	Pass
NVNT	ax20	5200	Ant2	5199.98	-20000	-3.85	25	Pass
NVNT	ax20	5240	Ant2	5239.98	-20000	-3.82	25	Pass
NVNT	ax40	5190	Ant2	5190	0	0	25	Pass
NVNT	ax40	5230	Ant2	5230	0	0	25	Pass
NVNT	ax80	5210	Ant2	5210	0	0	25	Pass



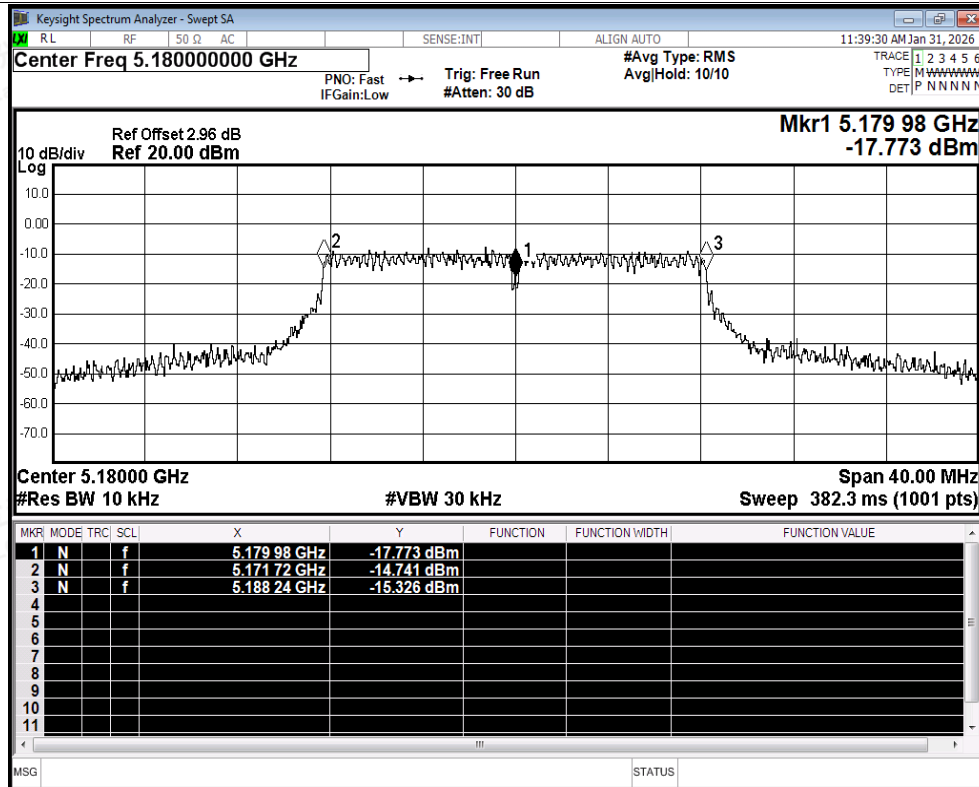

Freq. Stability NVNT a 5180MHz Ant2

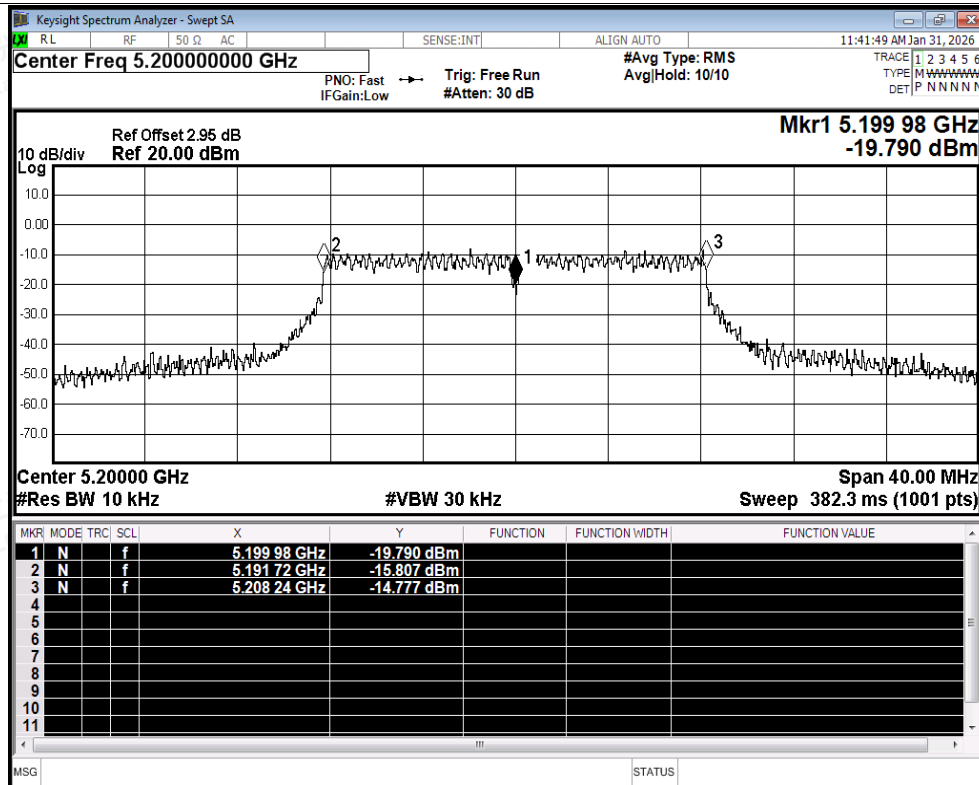

Freq. Stability NVNT a 5200MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

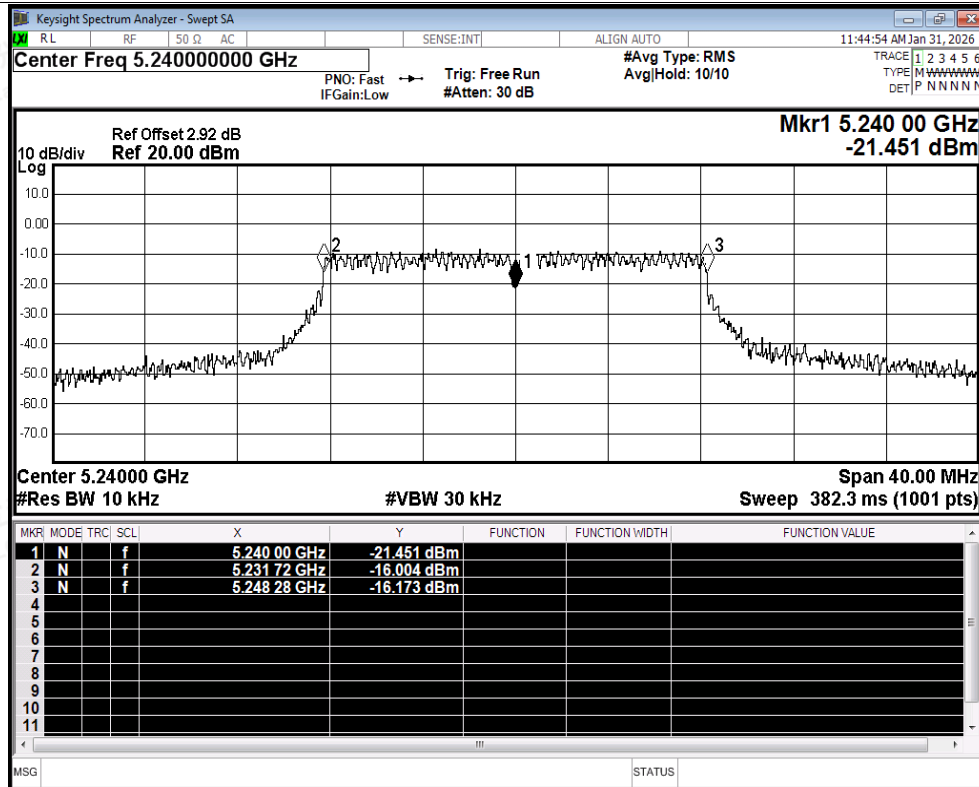

Freq. Stability NVNT a 5240MHz Ant2

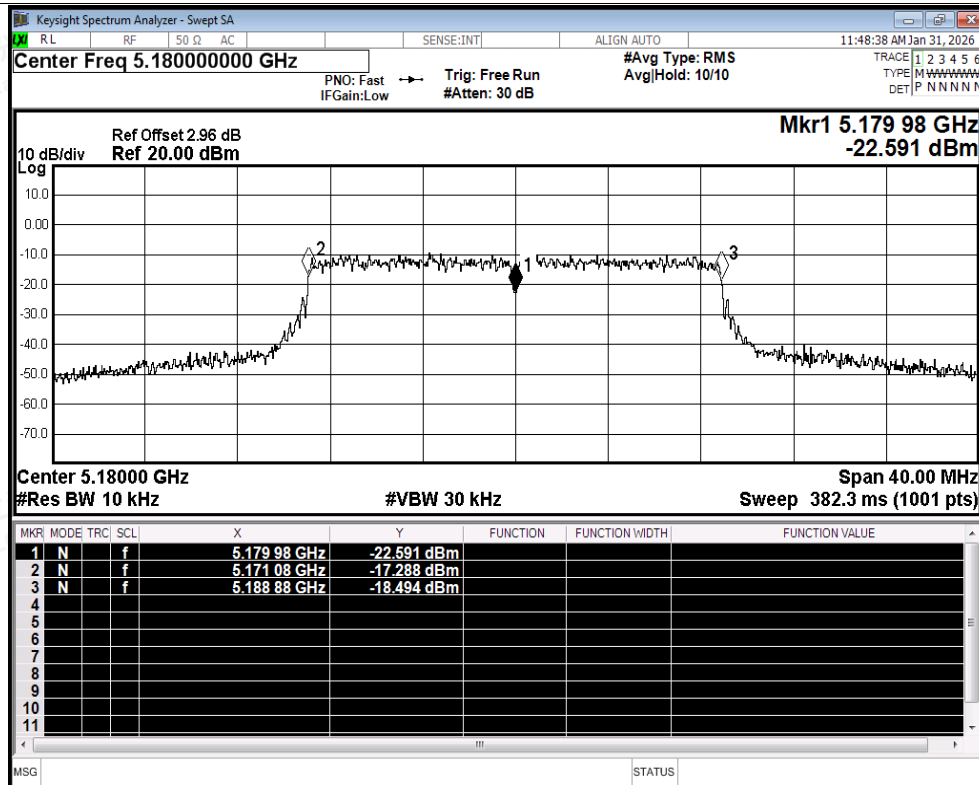

Freq. Stability NVNT n20 5180MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

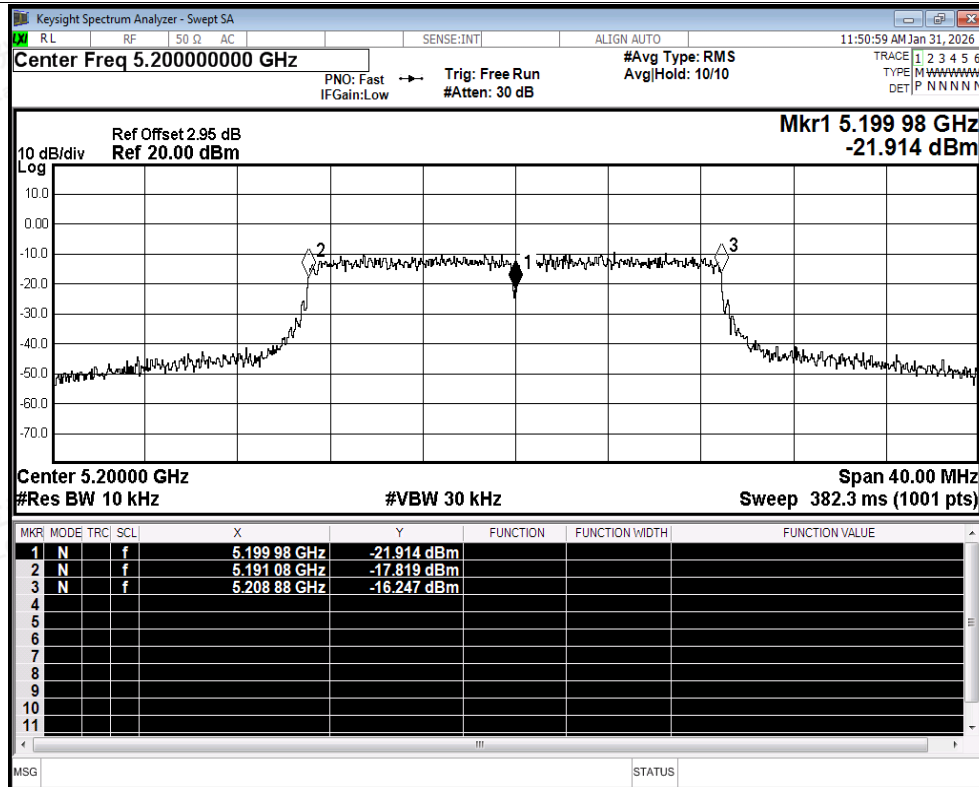

Freq. Stability NVNT n20 5200MHz Ant2

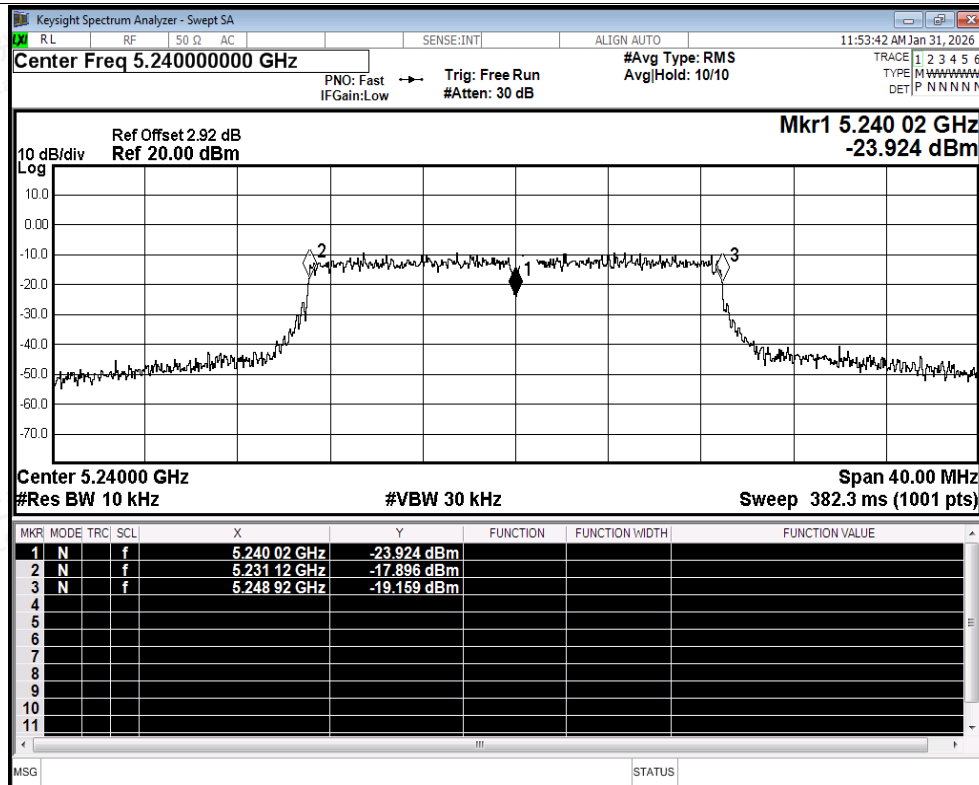

Freq. Stability NVNT n20 5240MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

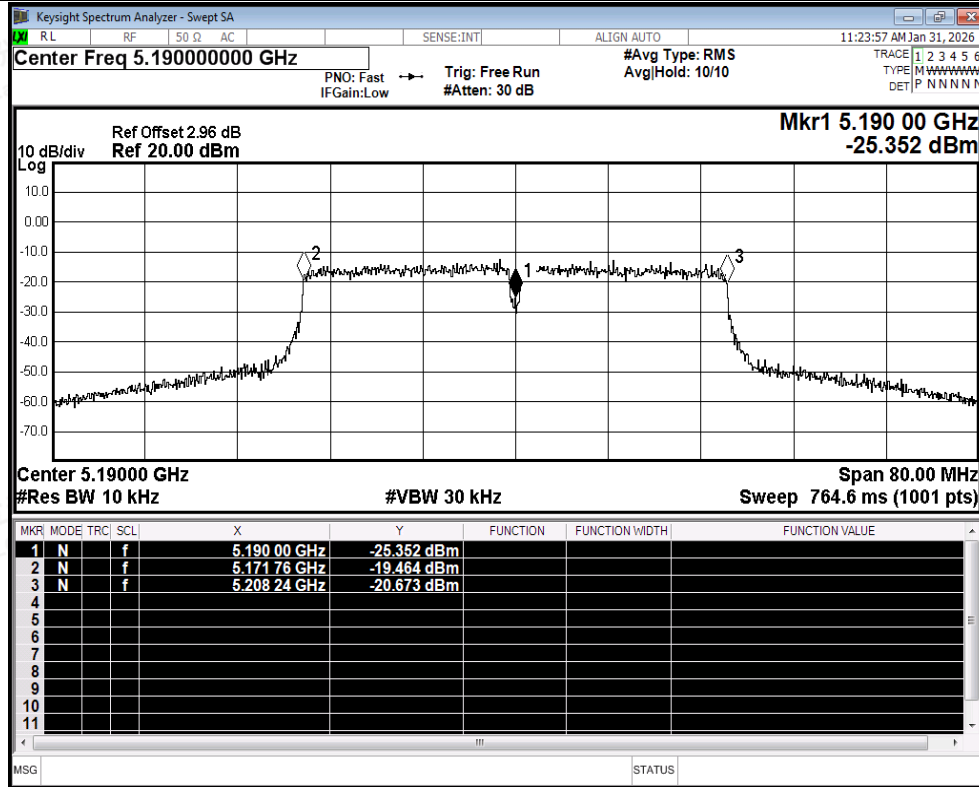

Freq. Stability NVNT n40 5190MHz Ant2

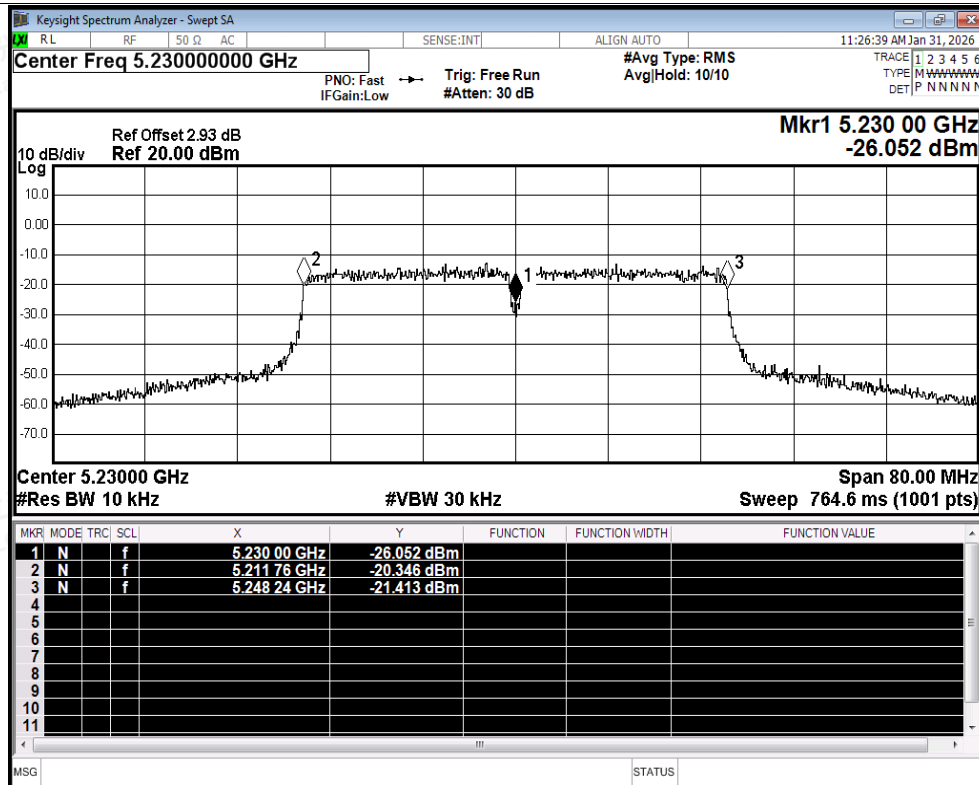

Freq. Stability NVNT n40 5230MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

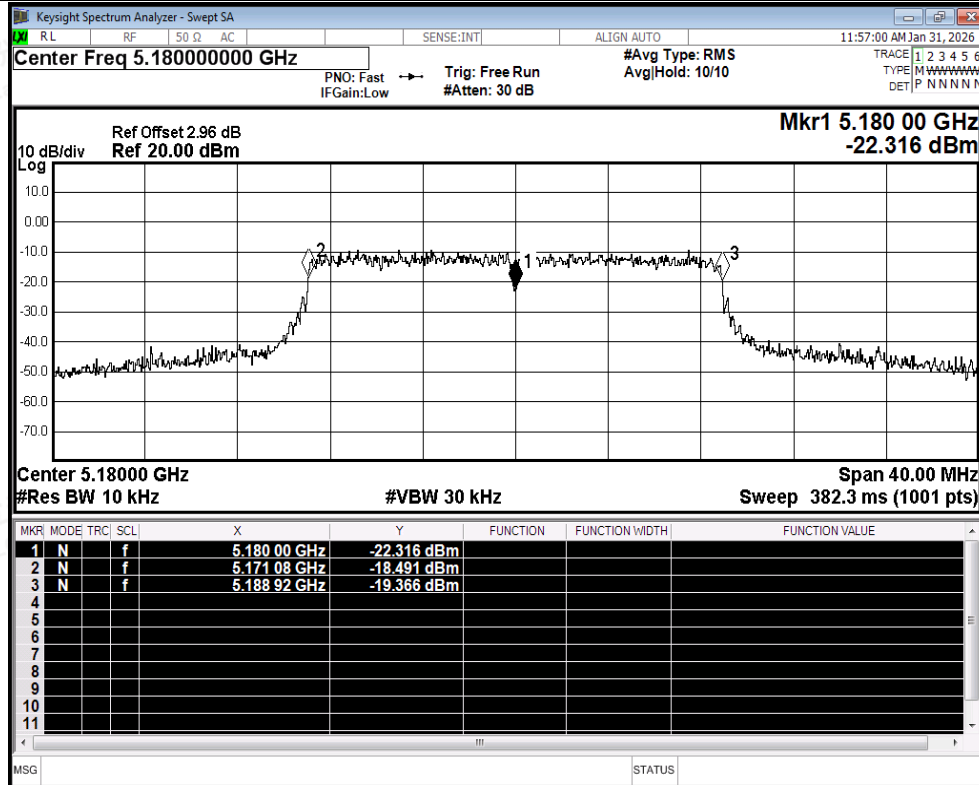

Freq. Stability NVNT ac20 5180MHz Ant2

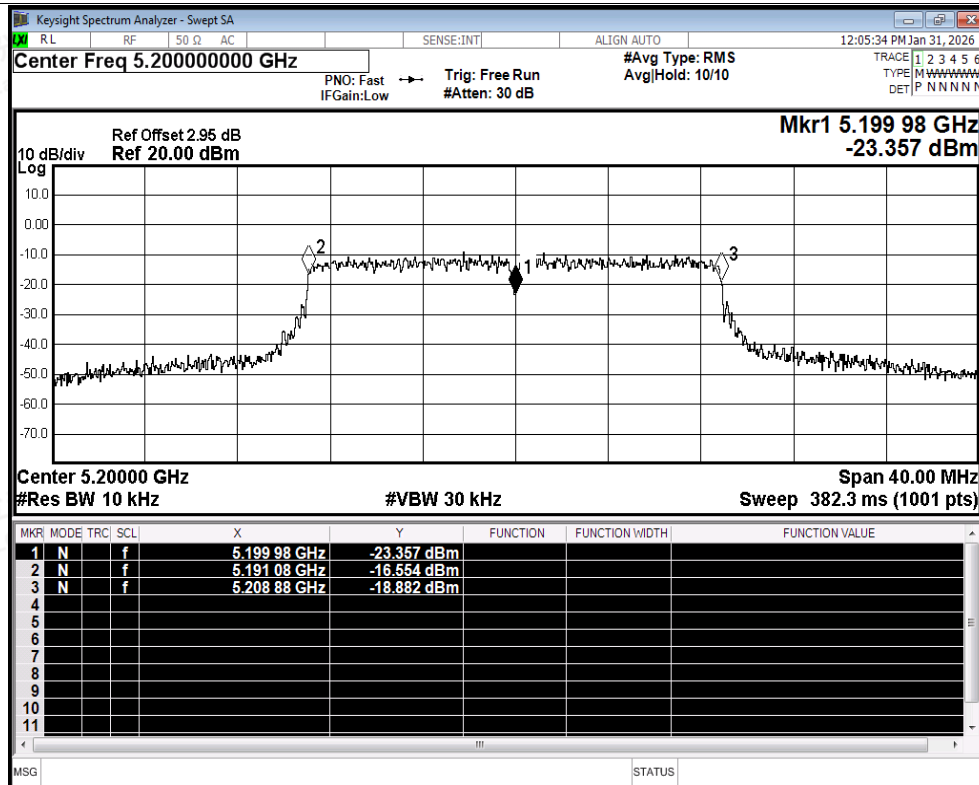

Freq. Stability NVNT ac20 5200MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

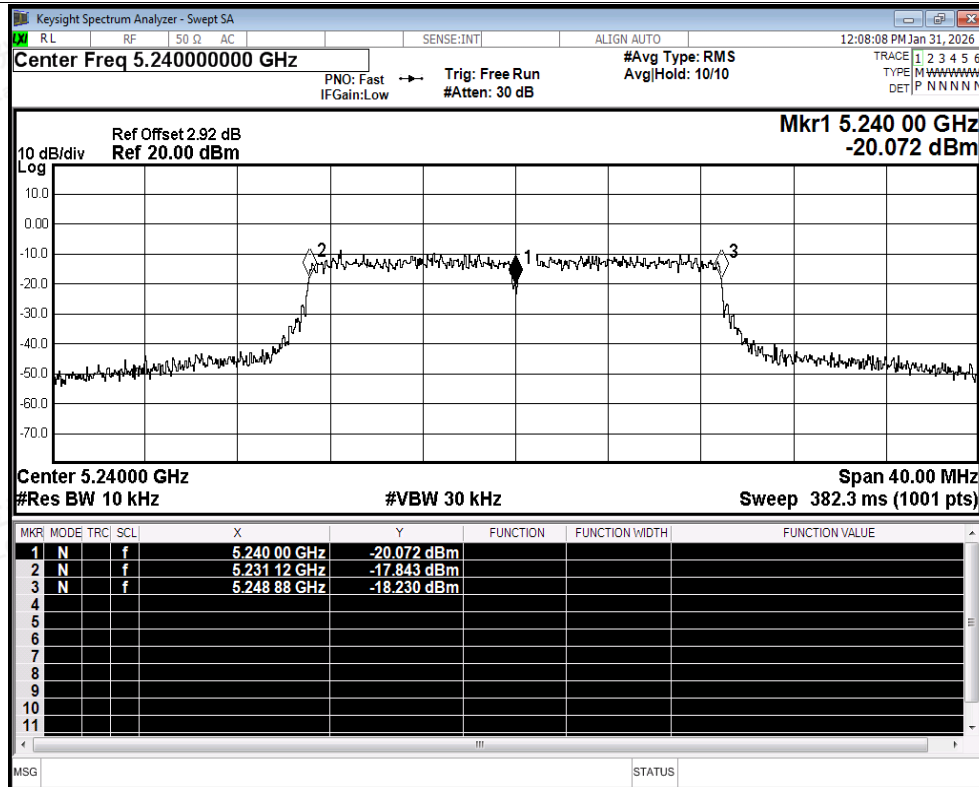


Freq. Stability NVNT ac20 5240MHz Ant2

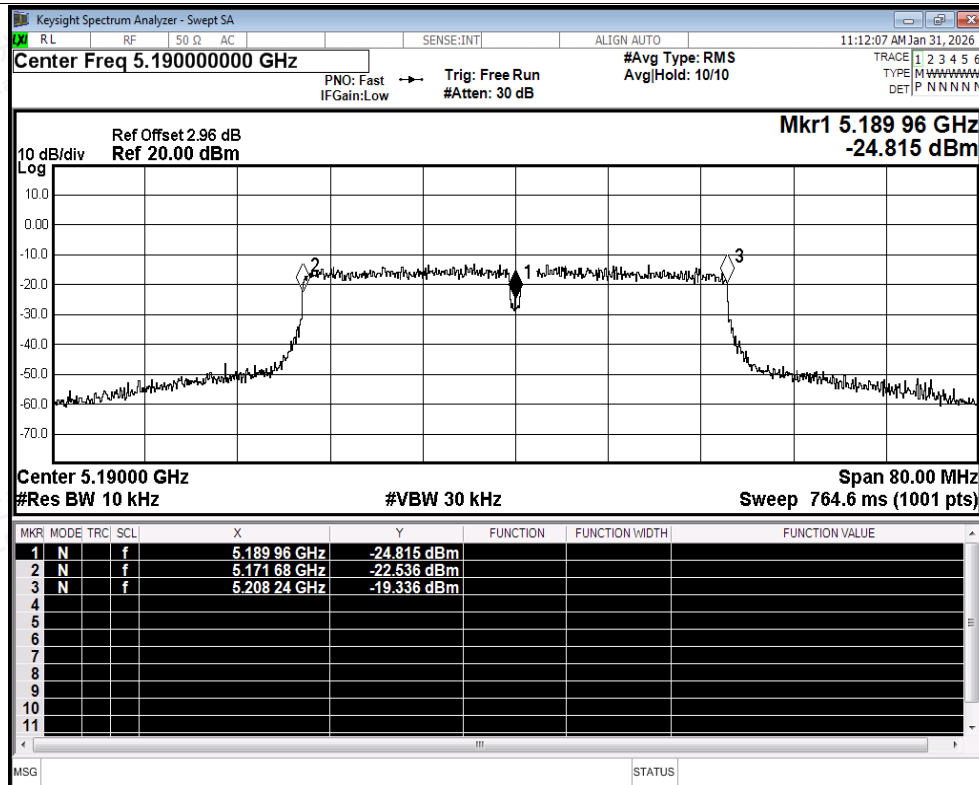


Freq. Stability NVNT ac40 5190MHz Ant2



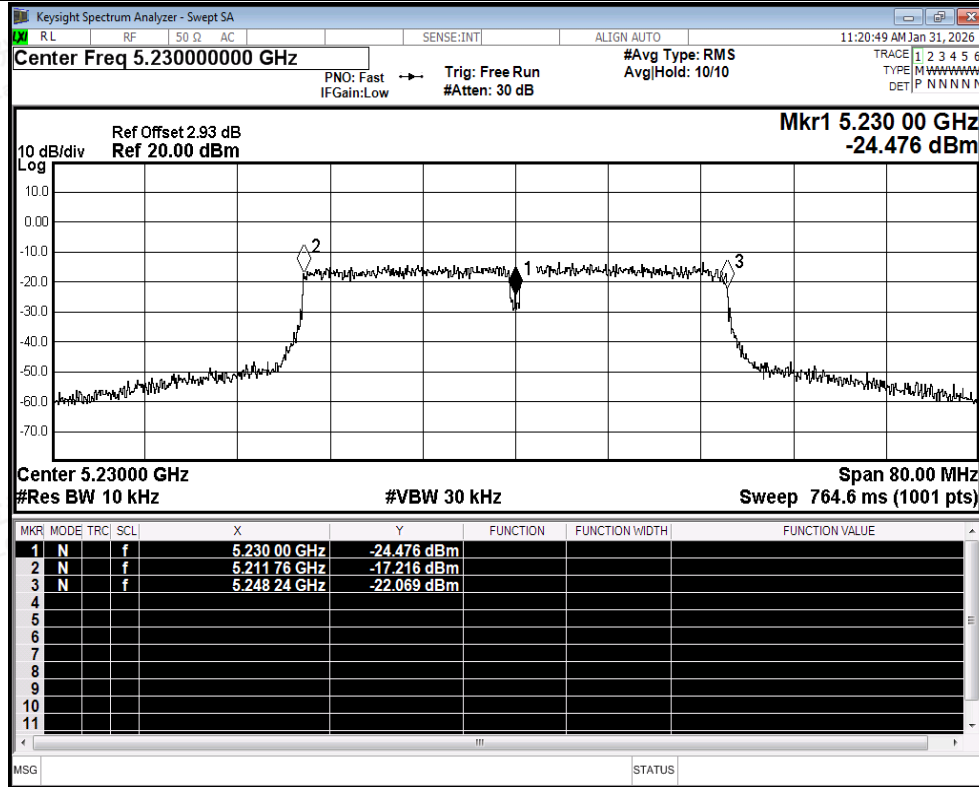

Freq. Stability NVNT ac40 5230MHz Ant2

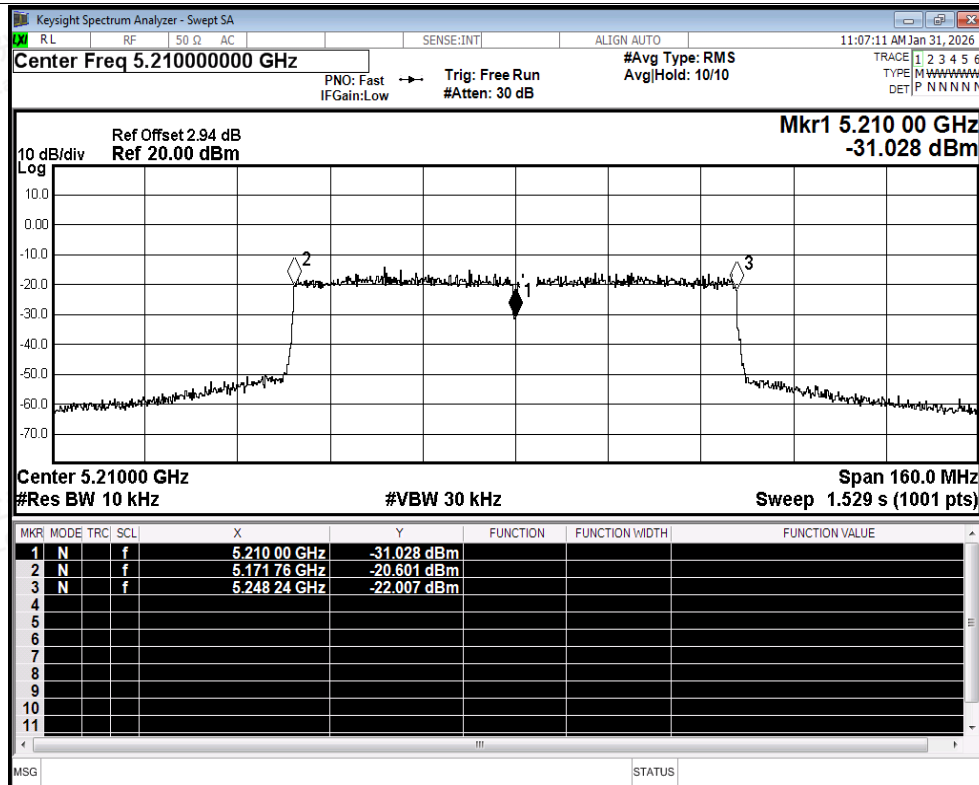

Freq. Stability NVNT ac80 5210MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

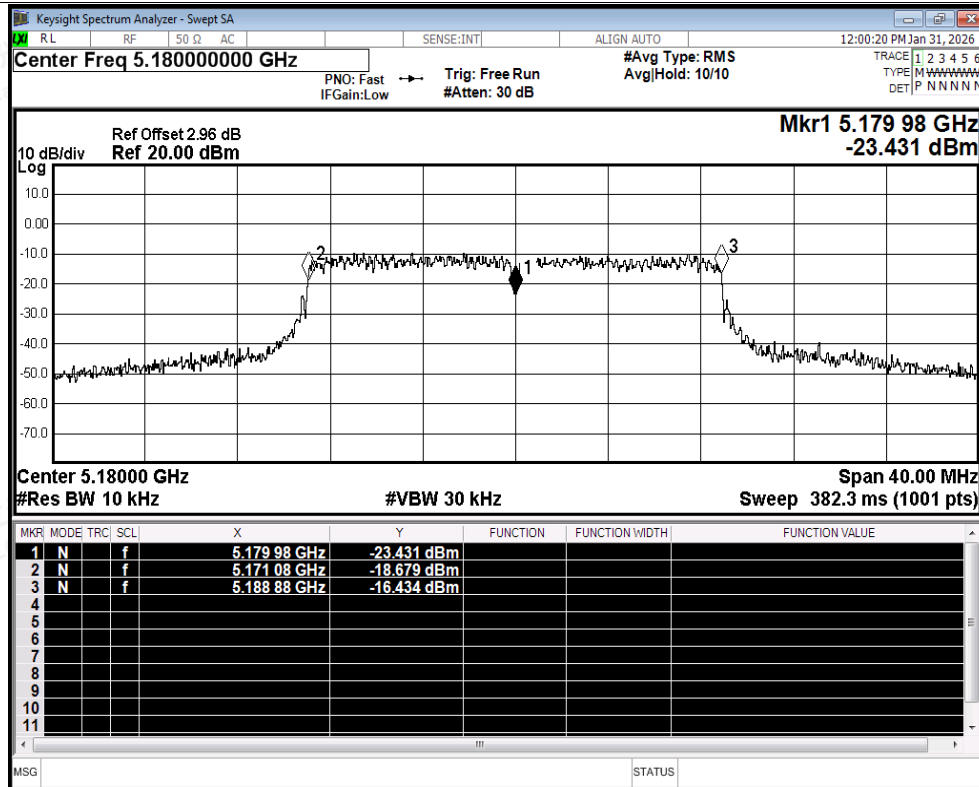

Freq. Stability NVNT ax20 5180MHz Ant2

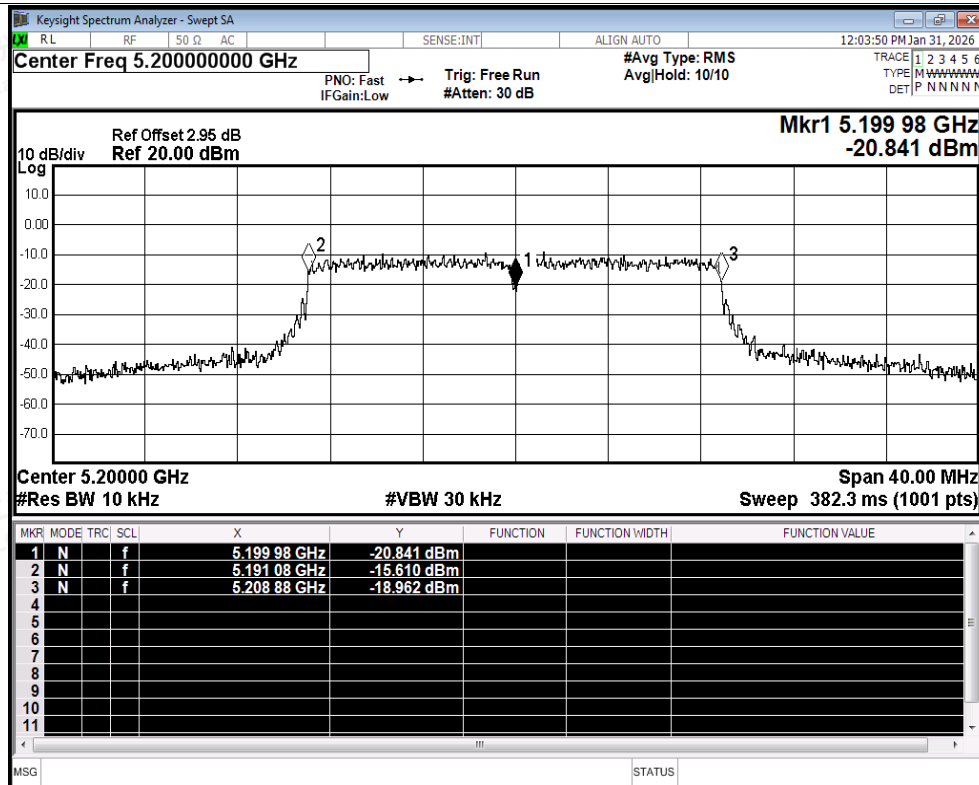

Freq. Stability NVNT ax20 5200MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

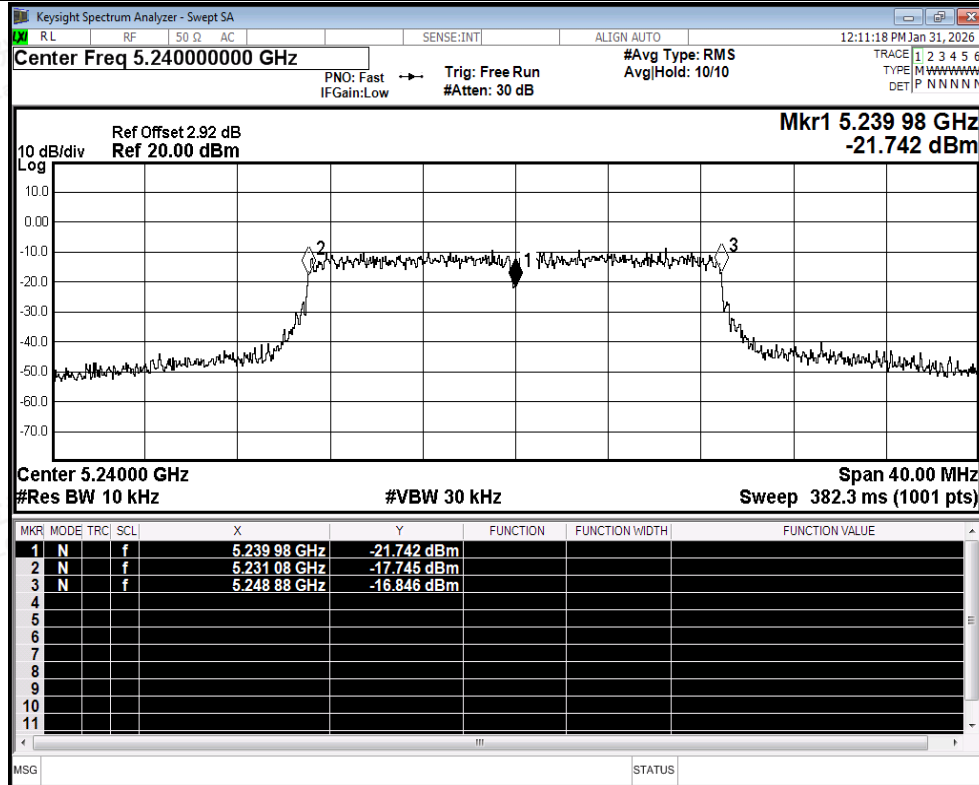

Freq. Stability NVNT ax20 5240MHz Ant2

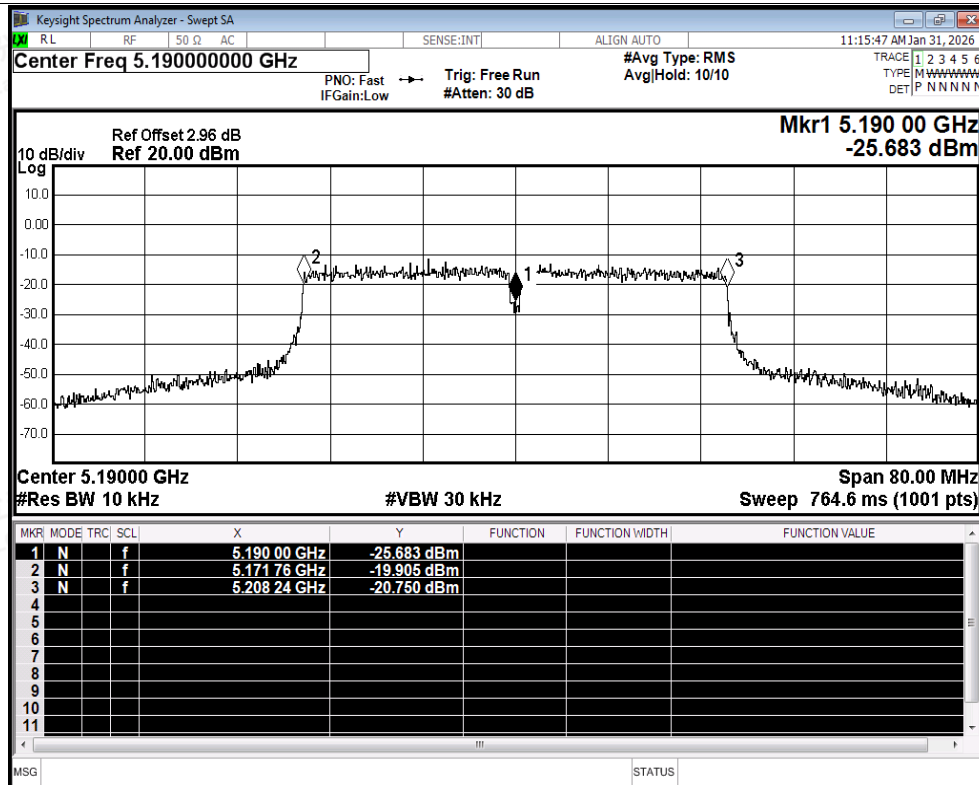

Freq. Stability NVNT ax40 5190MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

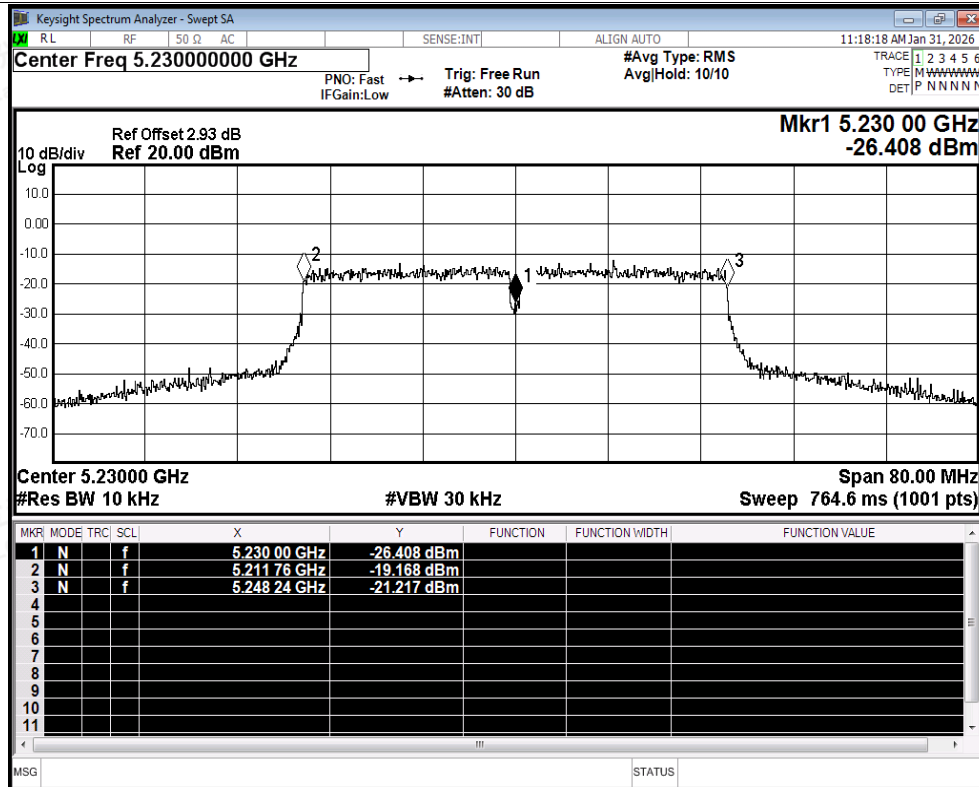

Freq. Stability NVNT ax40 5230MHz Ant2

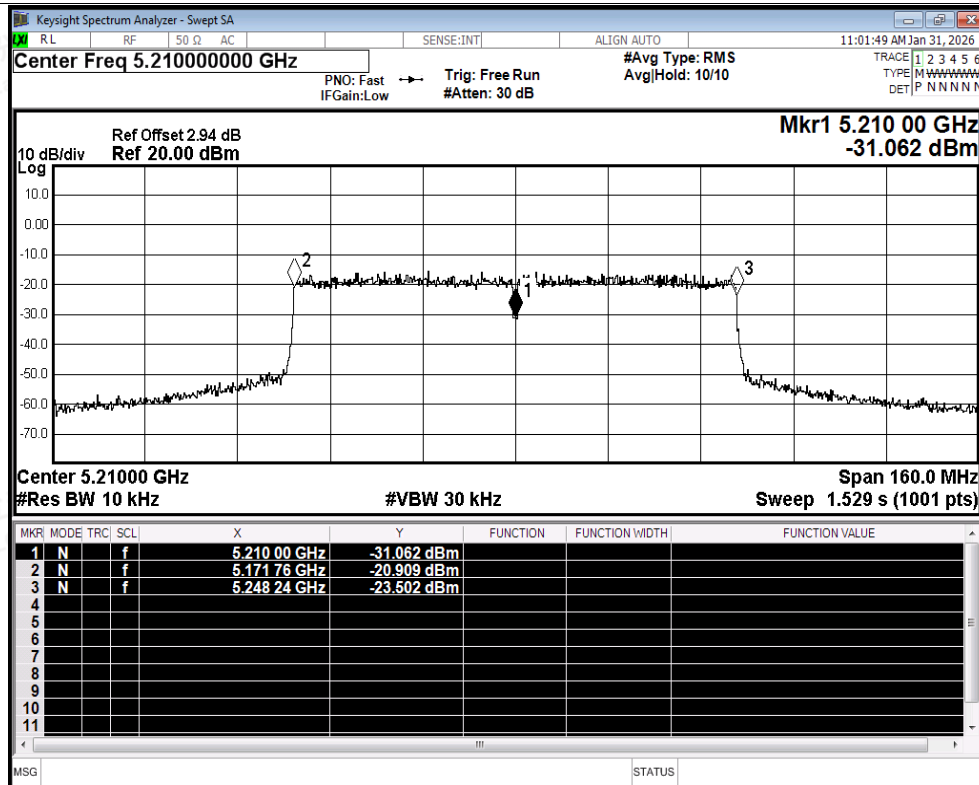

Freq. Stability NVNT ax80 5210MHz Ant2







D.6 Duty Cycle

Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5180	Ant1	97.82	0.1	0.37
NVNT	a	5200	Ant1	97.46	0.11	0.37
NVNT	a	5240	Ant1	97.83	0.1	0.37
NVNT	n20	5180	Ant1	97.41	0.11	0.44
NVNT	n20	5200	Ant1	97.41	0.11	0.44
NVNT	n20	5240	Ant1	97.41	0.11	0.44
NVNT	n40	5190	Ant1	94.87	0.23	0.9
NVNT	n40	5230	Ant1	94.87	0.23	0.9
NVNT	ac20	5180	Ant1	97.42	0.11	0.44
NVNT	ac20	5200	Ant1	97.42	0.11	0.44
NVNT	ac20	5240	Ant1	97.42	0.11	0.44
NVNT	ac40	5190	Ant1	94.87	0.23	0.9
NVNT	ac40	5230	Ant1	94.07	0.27	0.9
NVNT	ac80	5210	Ant1	90	0.46	1.85
NVNT	ax20	5180	Ant1	97	0.13	0.44
NVNT	ax20	5200	Ant1	97	0.13	0.44
NVNT	ax20	5240	Ant1	97.42	0.11	0.44
NVNT	ax40	5190	Ant1	94.92	0.23	0.89
NVNT	ax40	5230	Ant1	94.92	0.23	0.89
NVNT	ax80	5210	Ant1	90	0.46	1.85



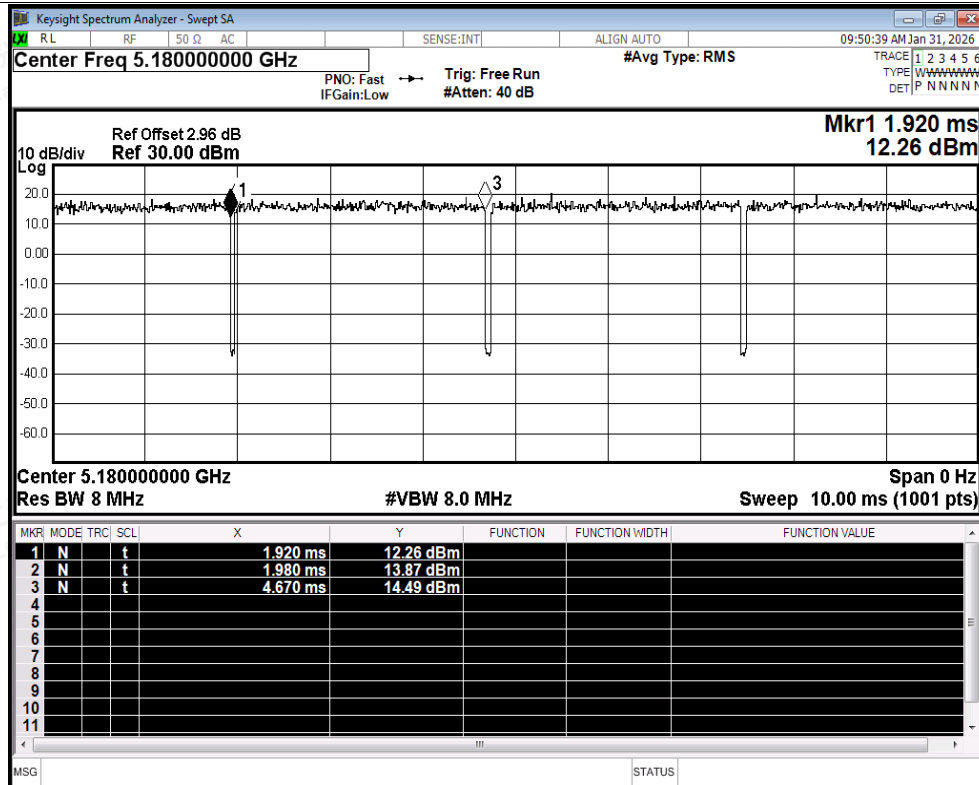


Duty Cycle NVNT a 5180MHz Ant1

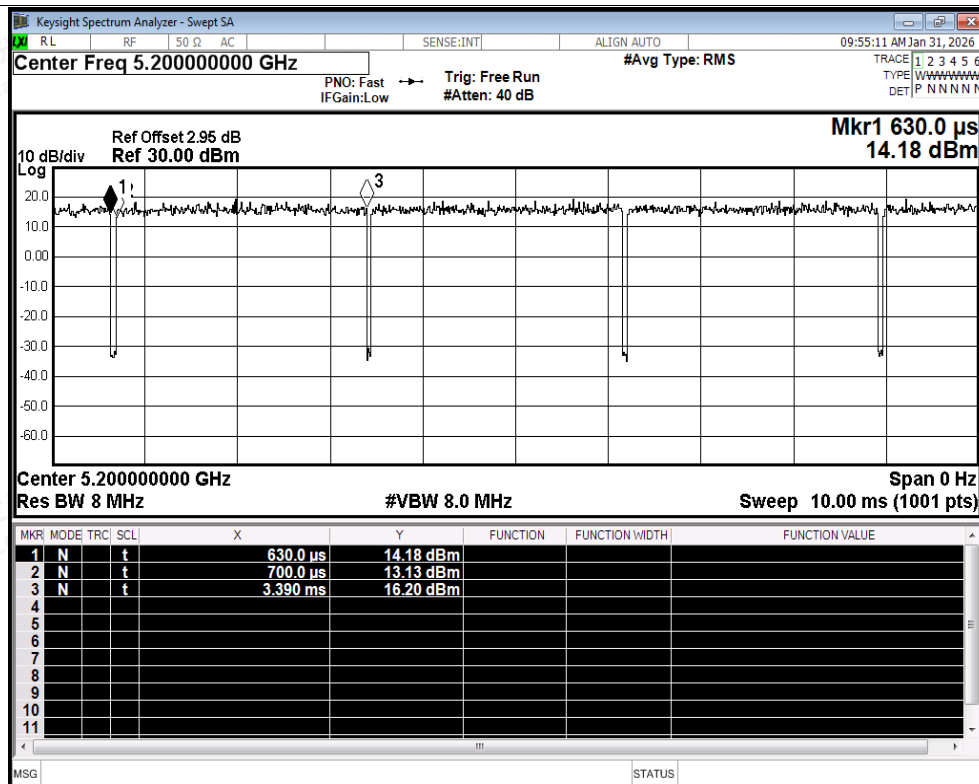


Duty Cycle NVNT a 5200MHz Ant1



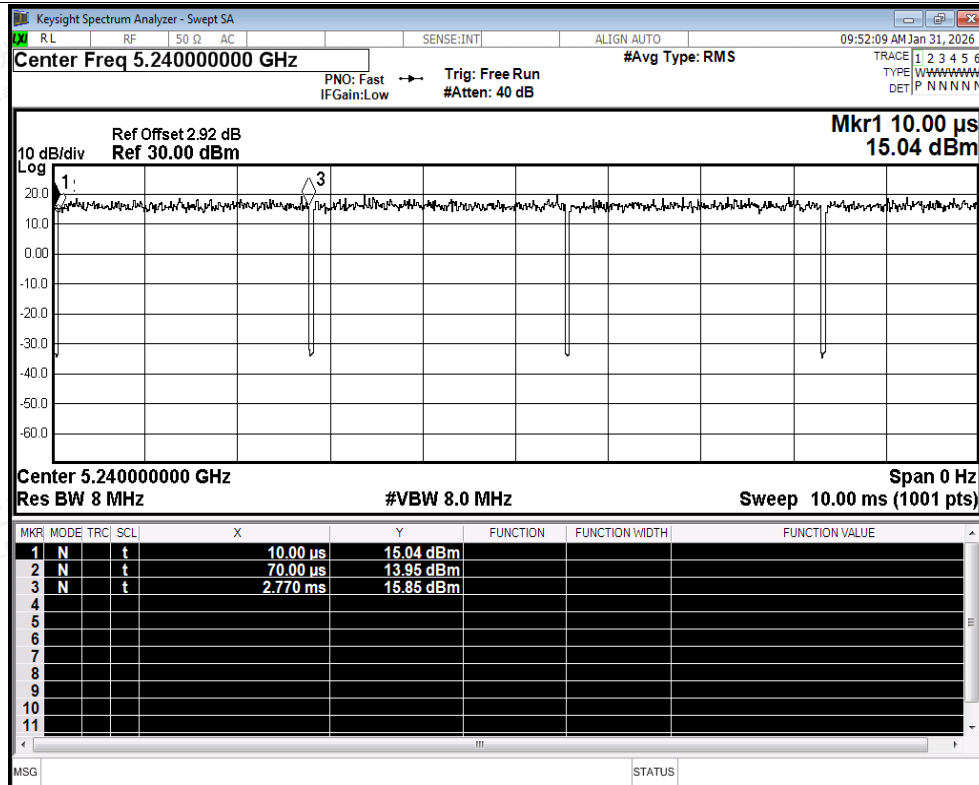


Duty Cycle NVNT a 5240MHz Ant1

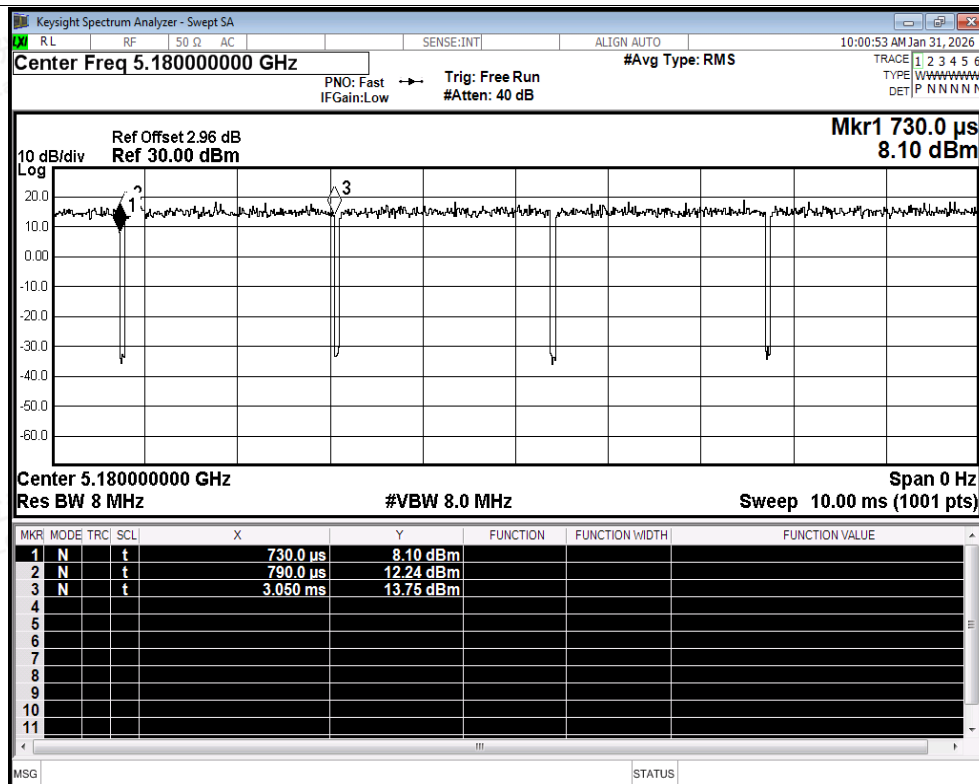


Duty Cycle NVNT n20 5180MHz Ant1



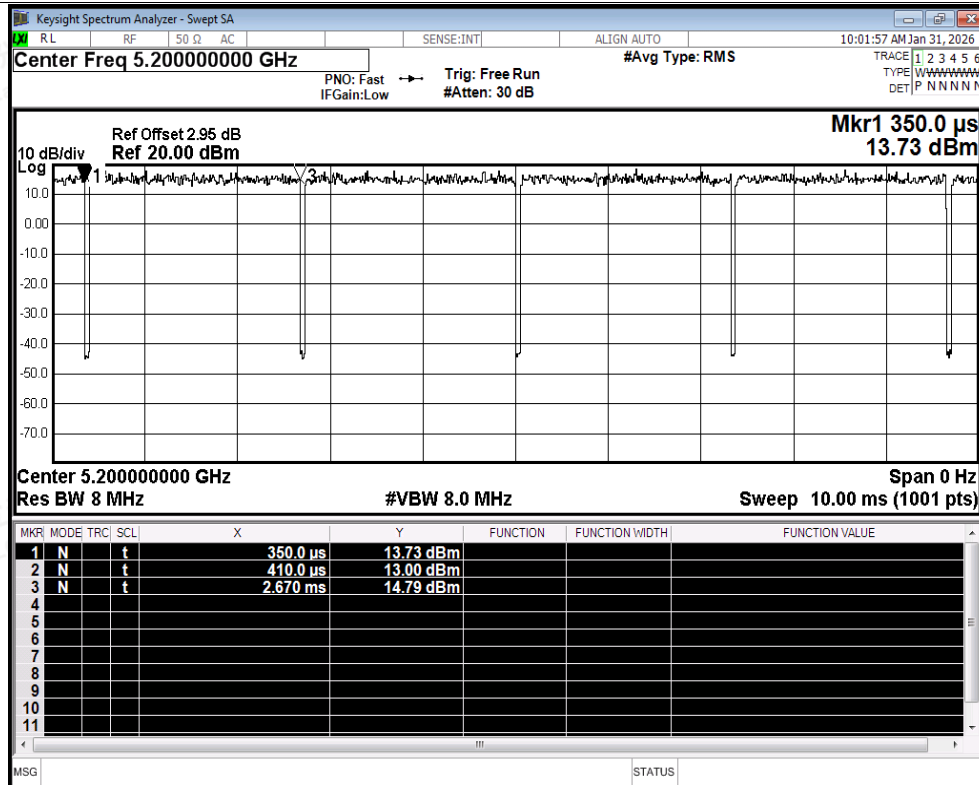

Duty Cycle NVNT n20 5200MHz Ant1

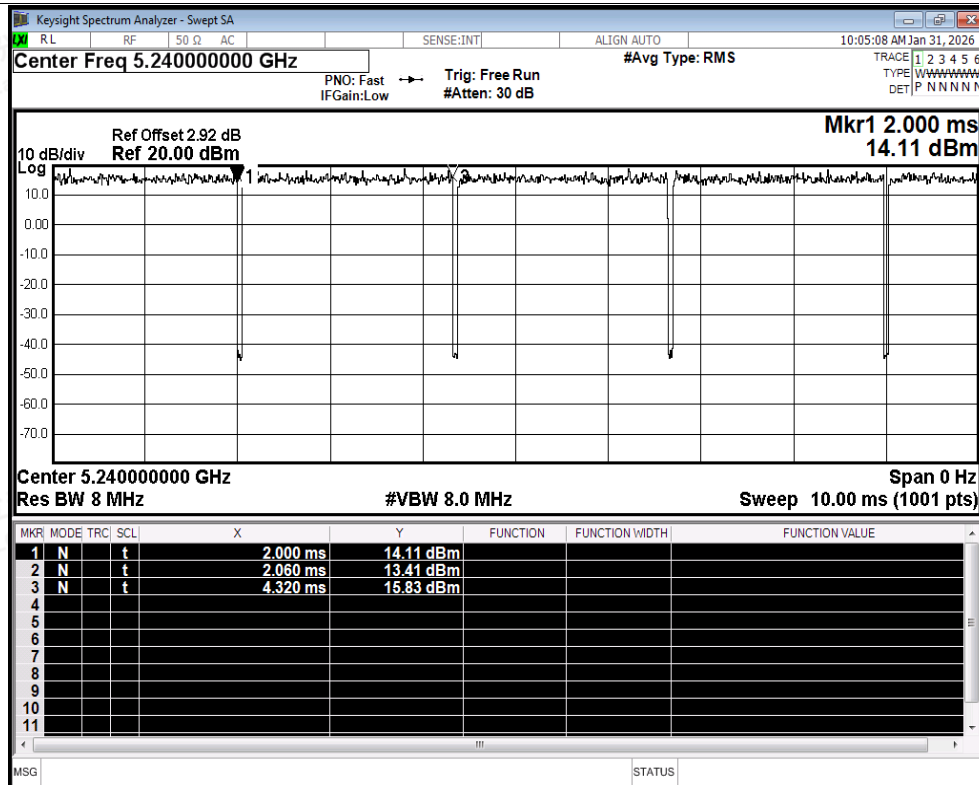

Duty Cycle NVNT n20 5240MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

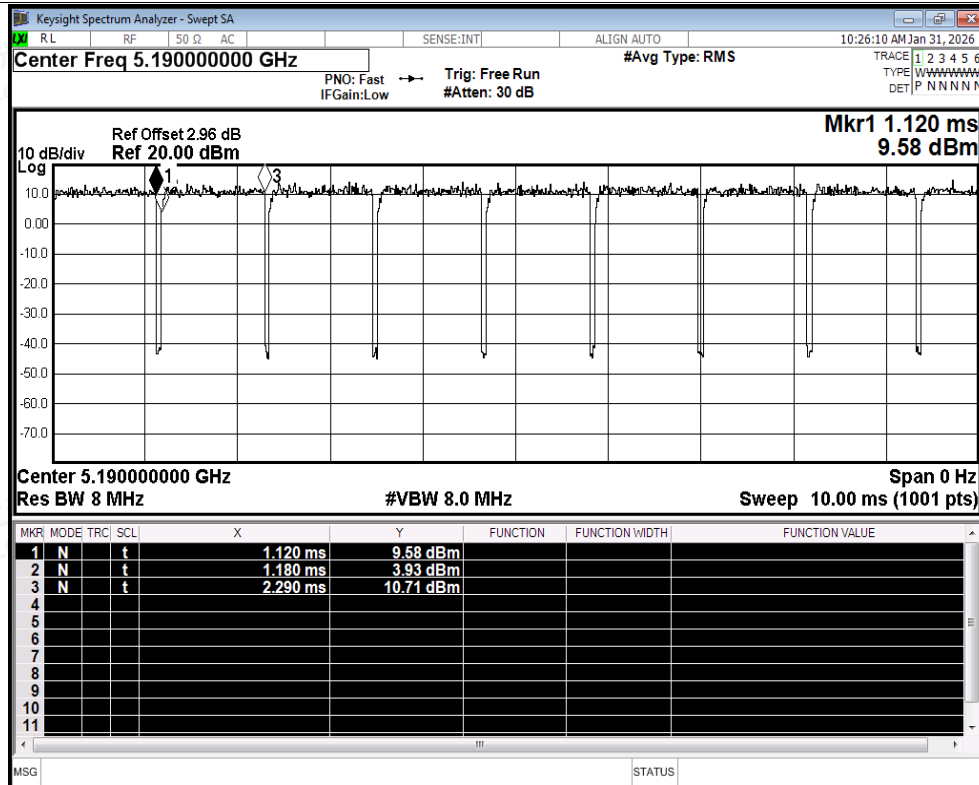


Duty Cycle NVNT n40 5190MHz Ant1

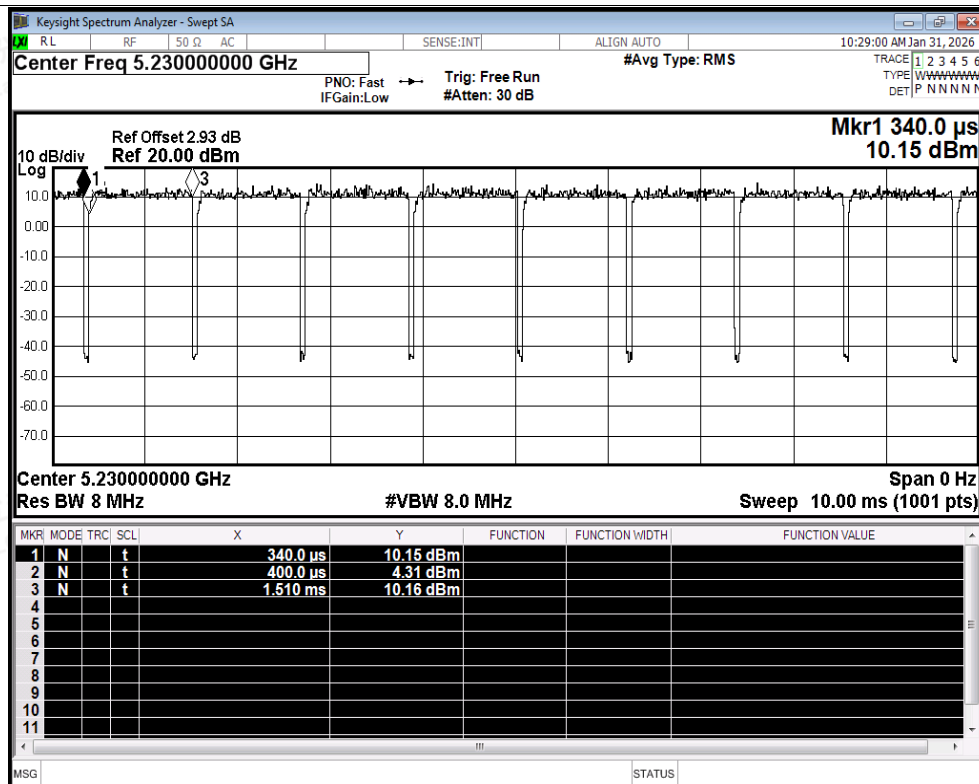


Duty Cycle NVNT n40 5230MHz Ant1



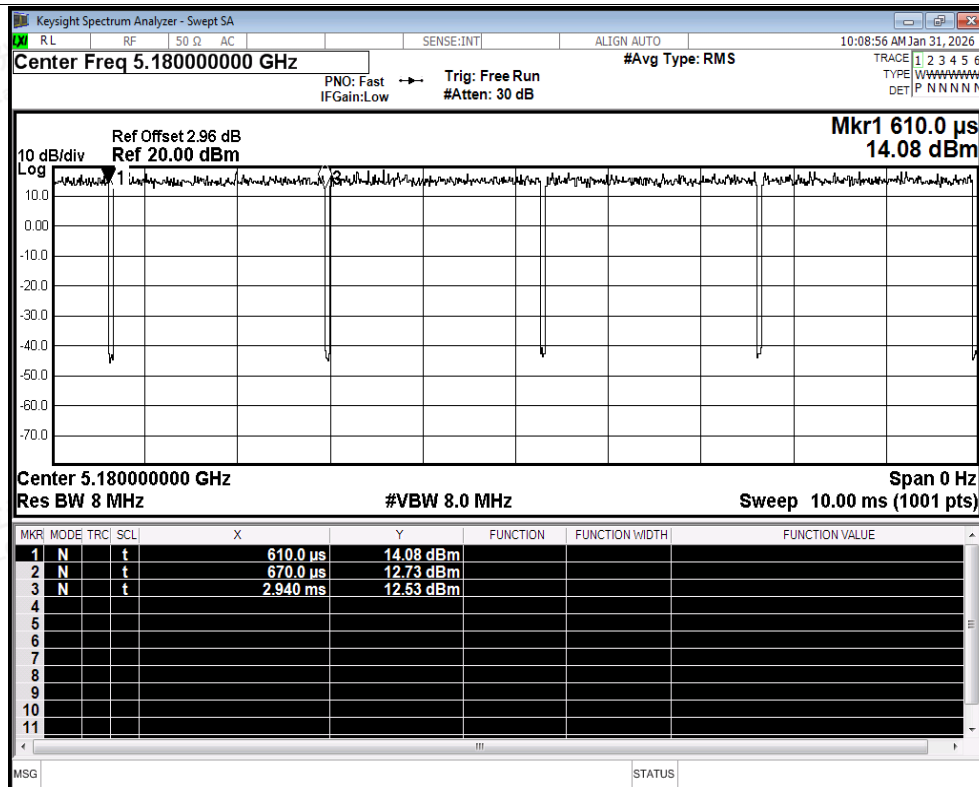

Duty Cycle NVNT ac20 5180MHz Ant1

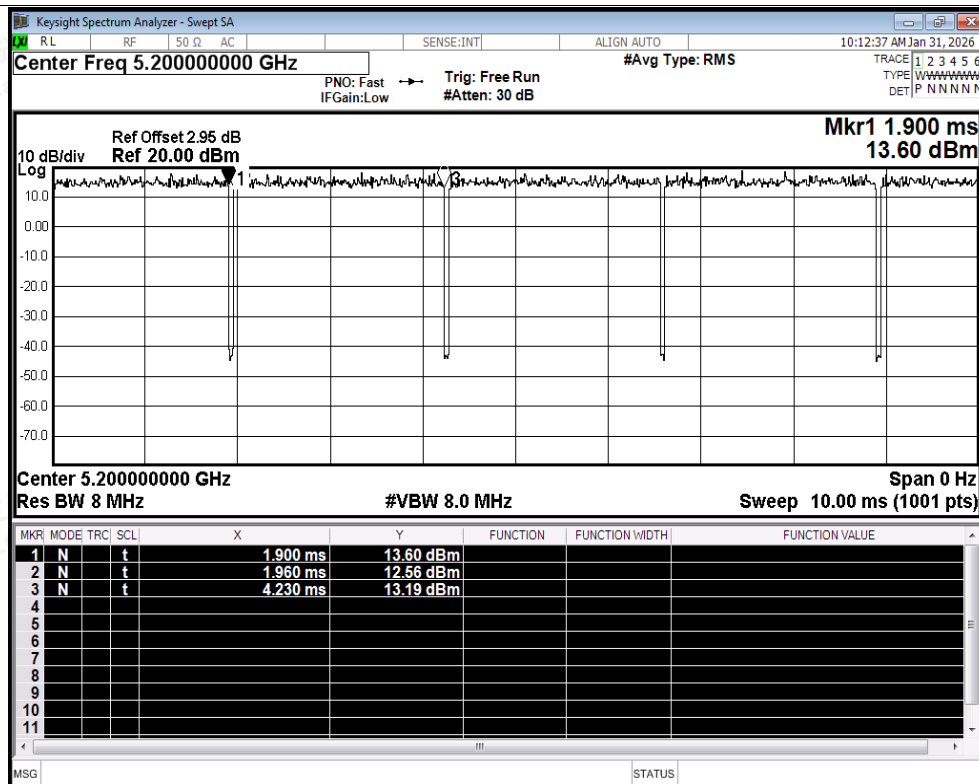

Duty Cycle NVNT ac20 5200MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

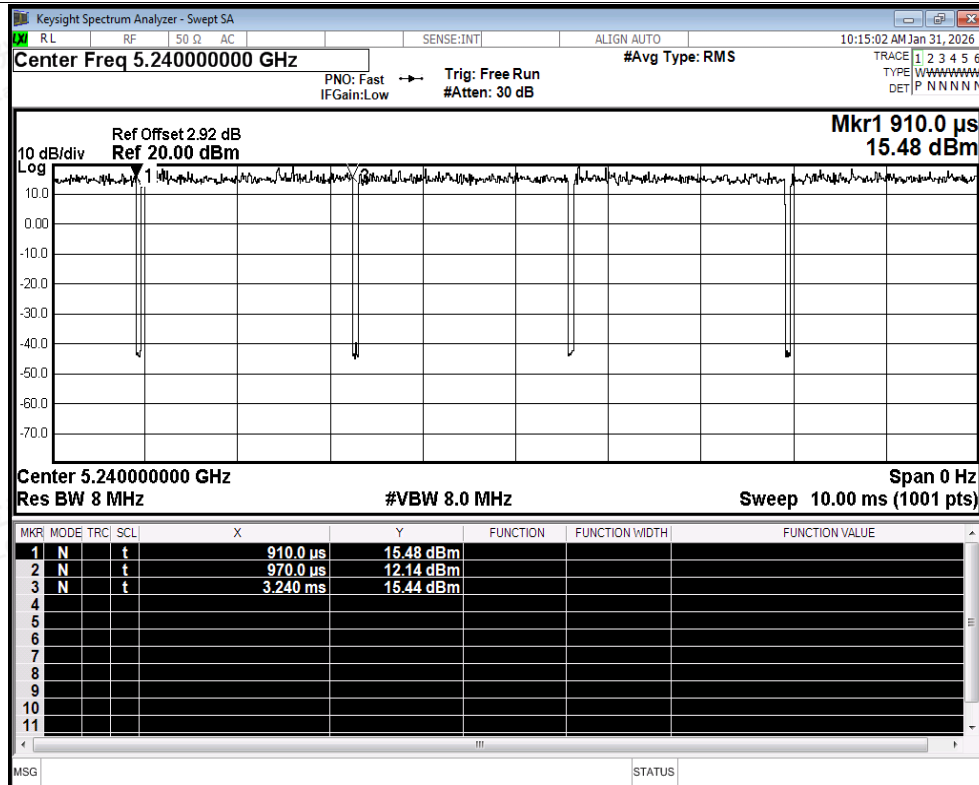


Duty Cycle NVNT ac20 5240MHz Ant1

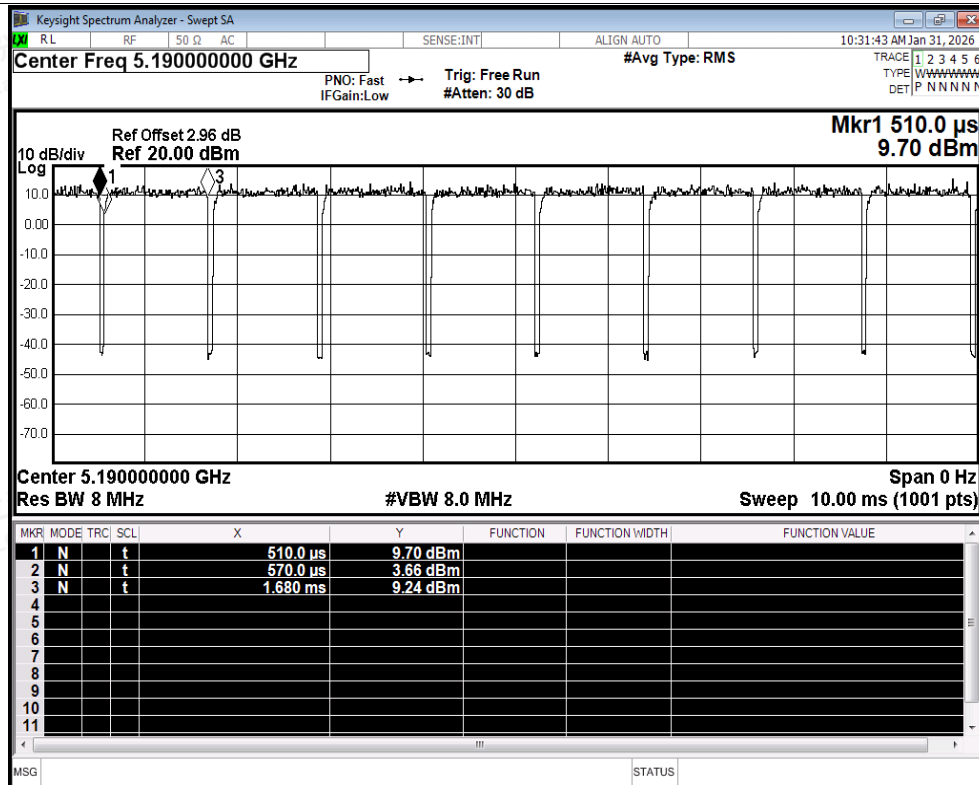


Duty Cycle NVNT ac40 5190MHz Ant1



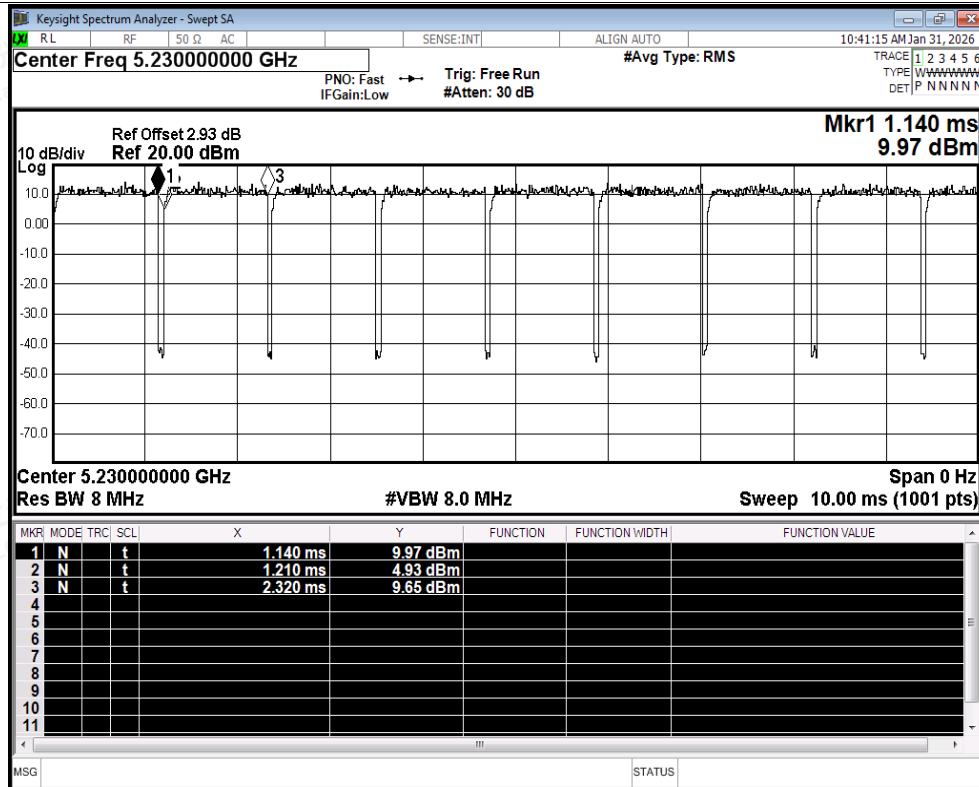

Duty Cycle NVNT ac40 5230MHz Ant1

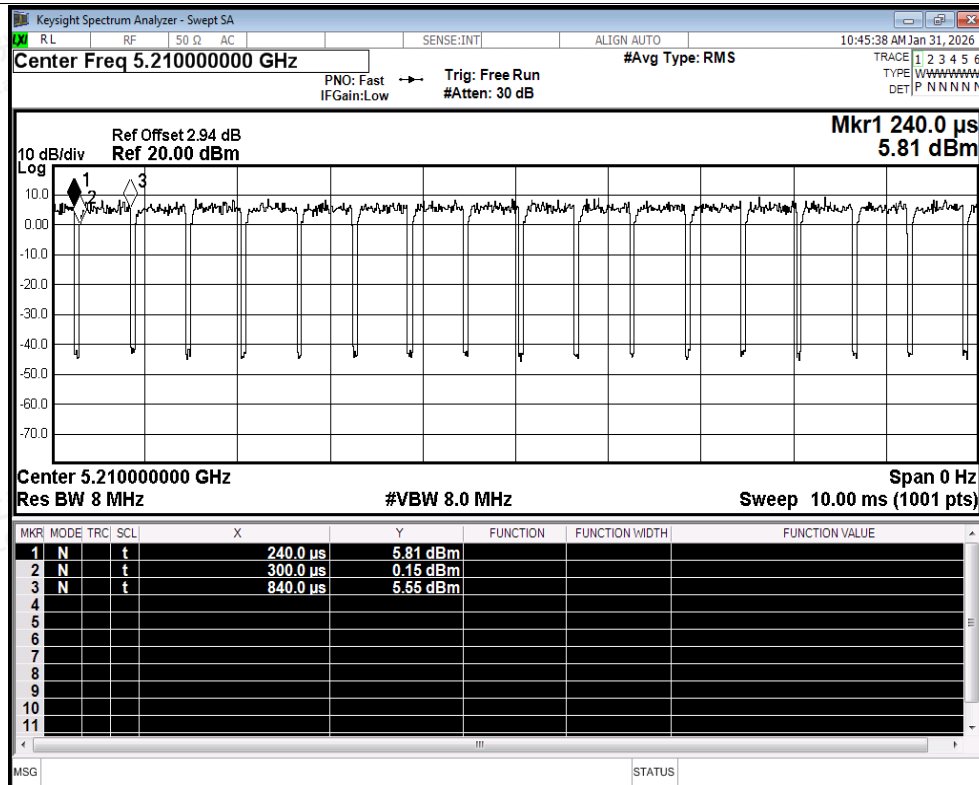

Duty Cycle NVNT ac80 5210MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

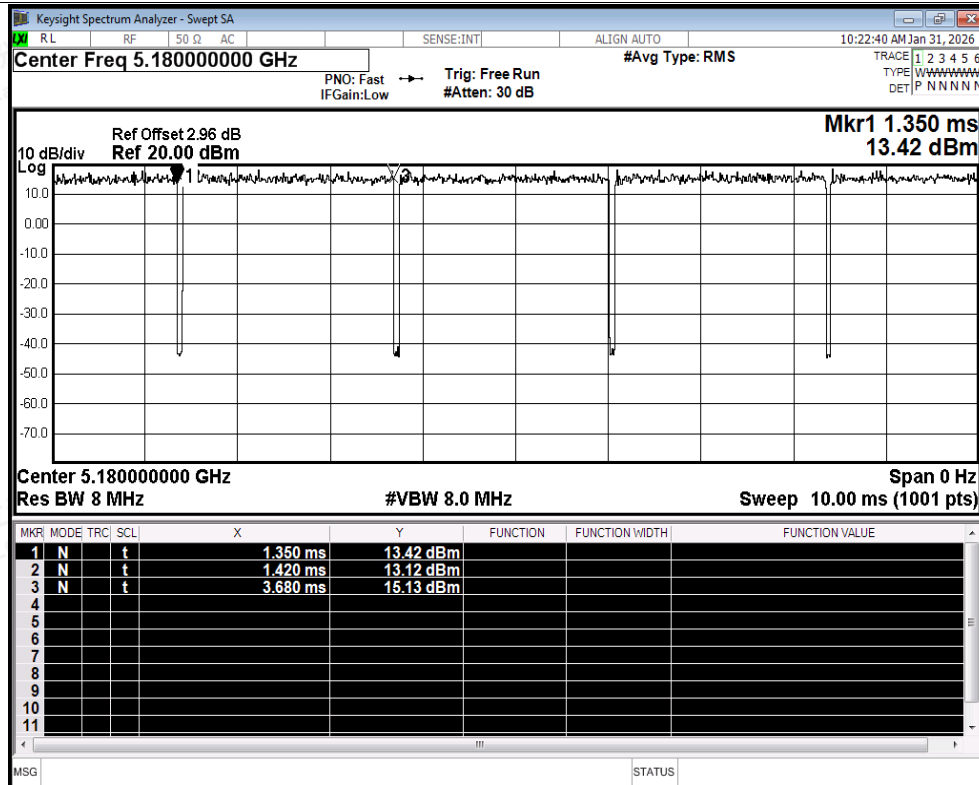

Duty Cycle NVNT ax20 5180MHz Ant1

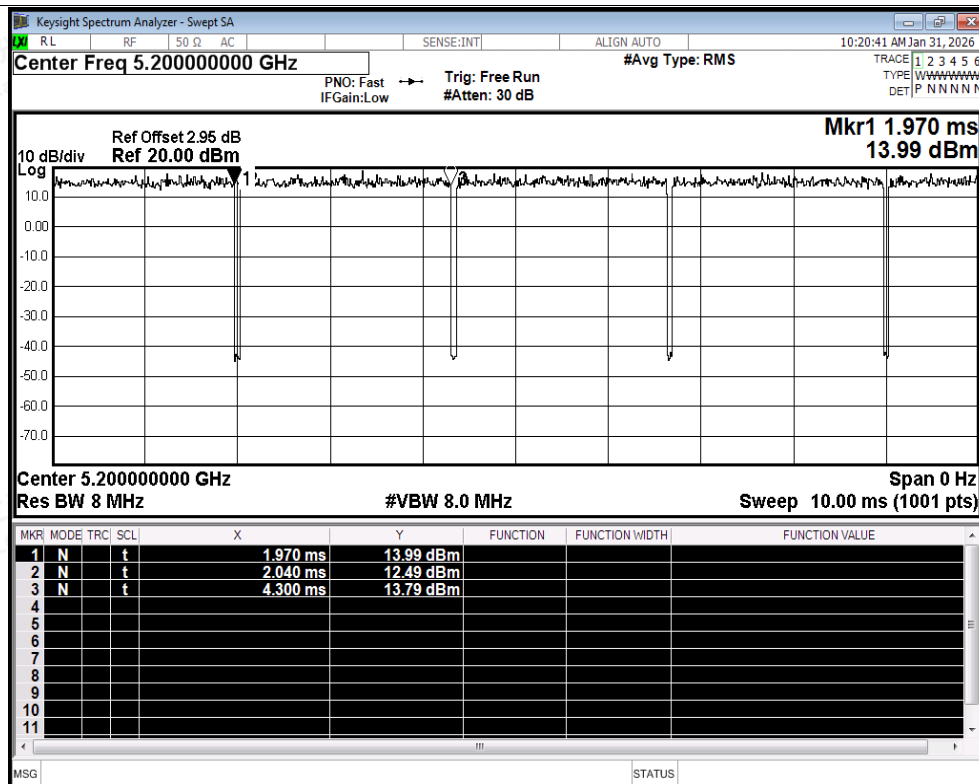

Duty Cycle NVNT ax20 5200MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

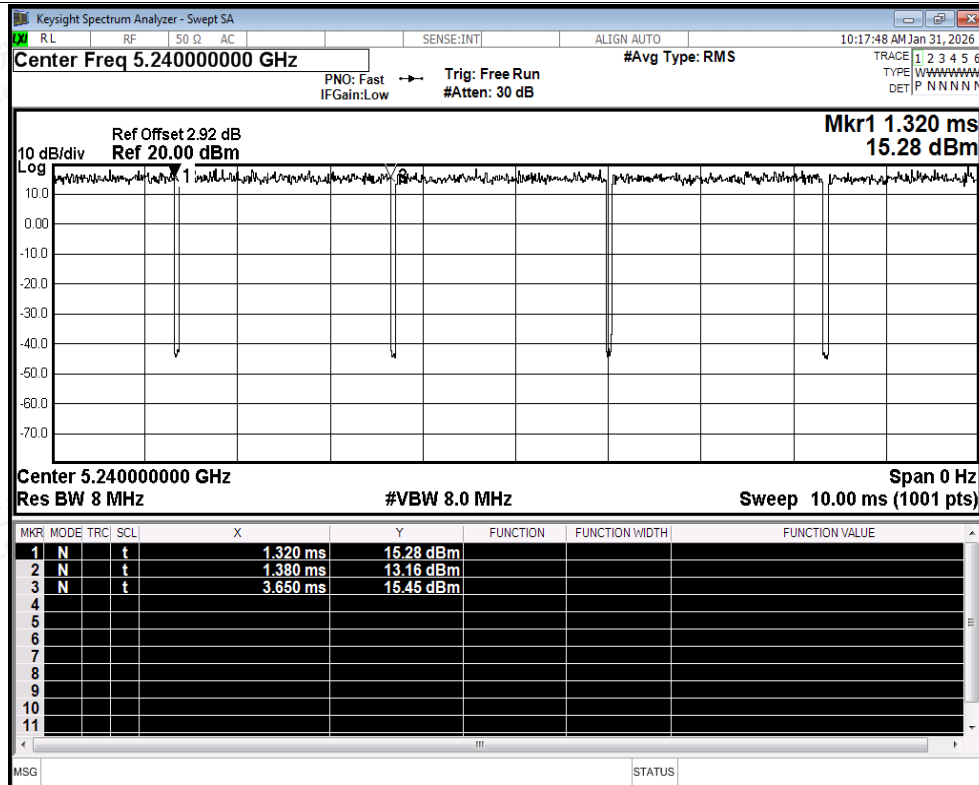

Duty Cycle NVNT ax20 5240MHz Ant1

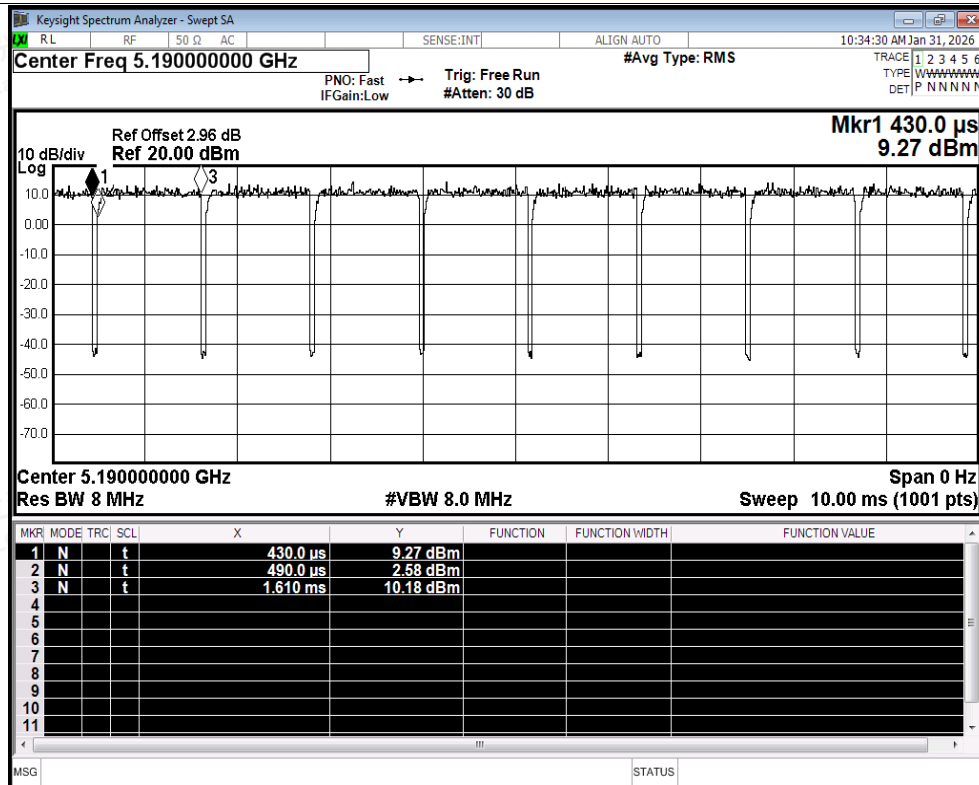

Duty Cycle NVNT ax40 5190MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

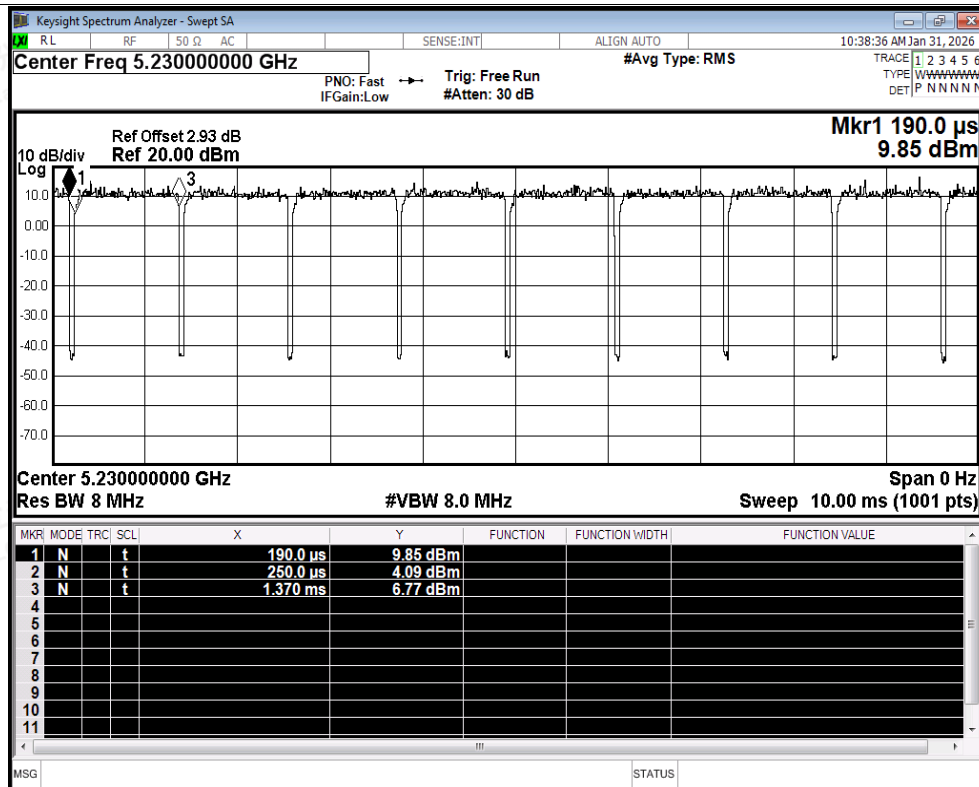

Duty Cycle NVNT ax40 5230MHz Ant1

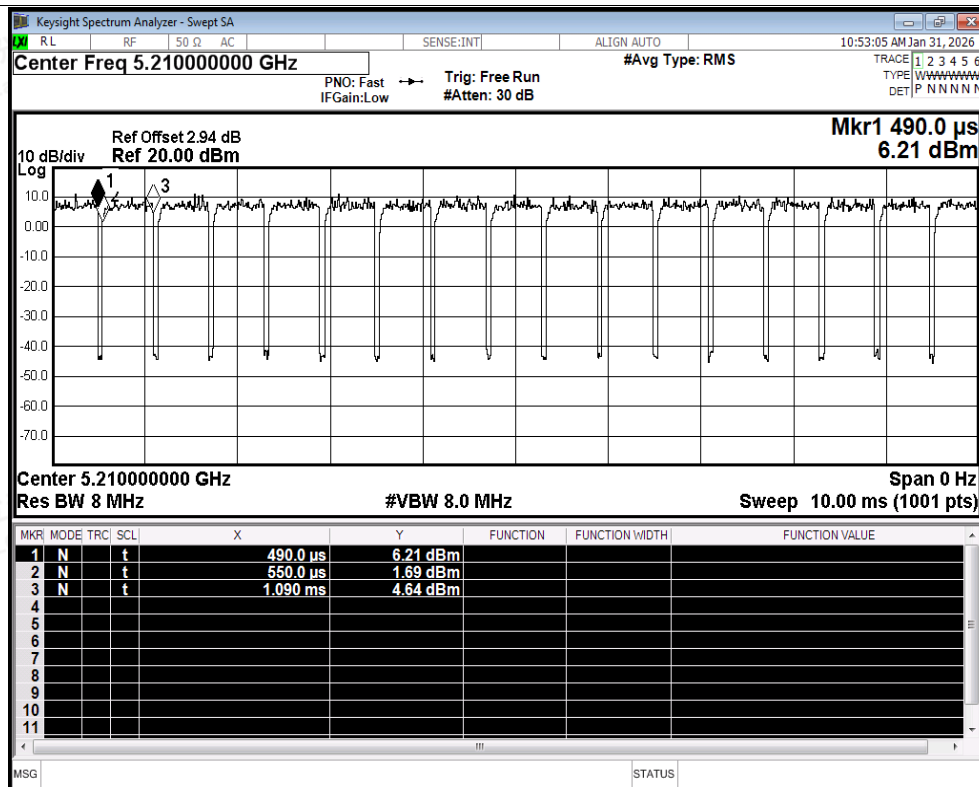

Duty Cycle NVNT ax80 5210MHz Ant1



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5180	Ant2	97.83	0.1	0.37
NVNT	a	5200	Ant2	97.82	0.1	0.37
NVNT	a	5240	Ant2	97.83	0.1	0.37
NVNT	n20	5180	Ant2	97.41	0.11	0.44
NVNT	n20	5200	Ant2	97	0.13	0.44
NVNT	n20	5240	Ant2	97.41	0.11	0.44
NVNT	n40	5190	Ant2	94.87	0.23	0.9
NVNT	n40	5230	Ant2	94.07	0.27	0.9
NVNT	ac20	5180	Ant2	97.42	0.11	0.44
NVNT	ac20	5200	Ant2	97.42	0.11	0.44
NVNT	ac20	5240	Ant2	97.42	0.11	0.44
NVNT	ac40	5190	Ant2	94.92	0.23	0.89
NVNT	ac40	5230	Ant2	94.87	0.23	0.9
NVNT	ac80	5210	Ant2	89.83	0.47	1.89
NVNT	ax20	5180	Ant2	97	0.13	0.44
NVNT	ax20	5200	Ant2	97	0.13	0.44
NVNT	ax20	5240	Ant2	97.42	0.11	0.44
NVNT	ax40	5190	Ant2	94.07	0.27	0.9
NVNT	ax40	5230	Ant2	94.87	0.23	0.9
NVNT	ax80	5210	Ant2	90	0.46	1.85




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

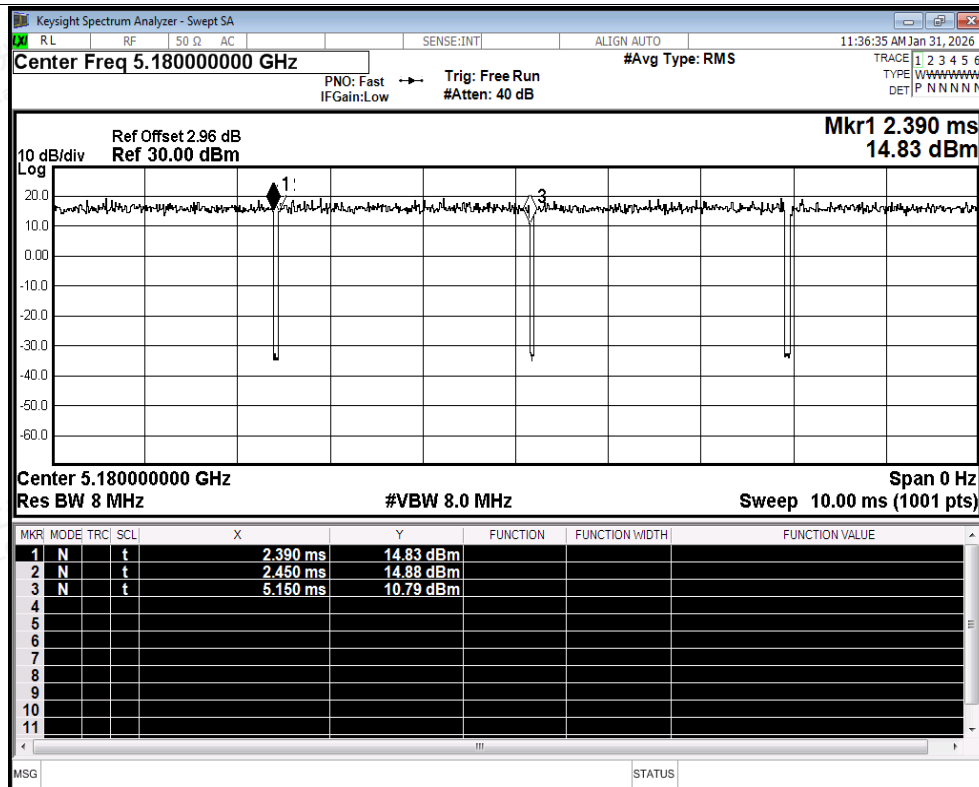

Duty Cycle NVNT a 5180MHz Ant2

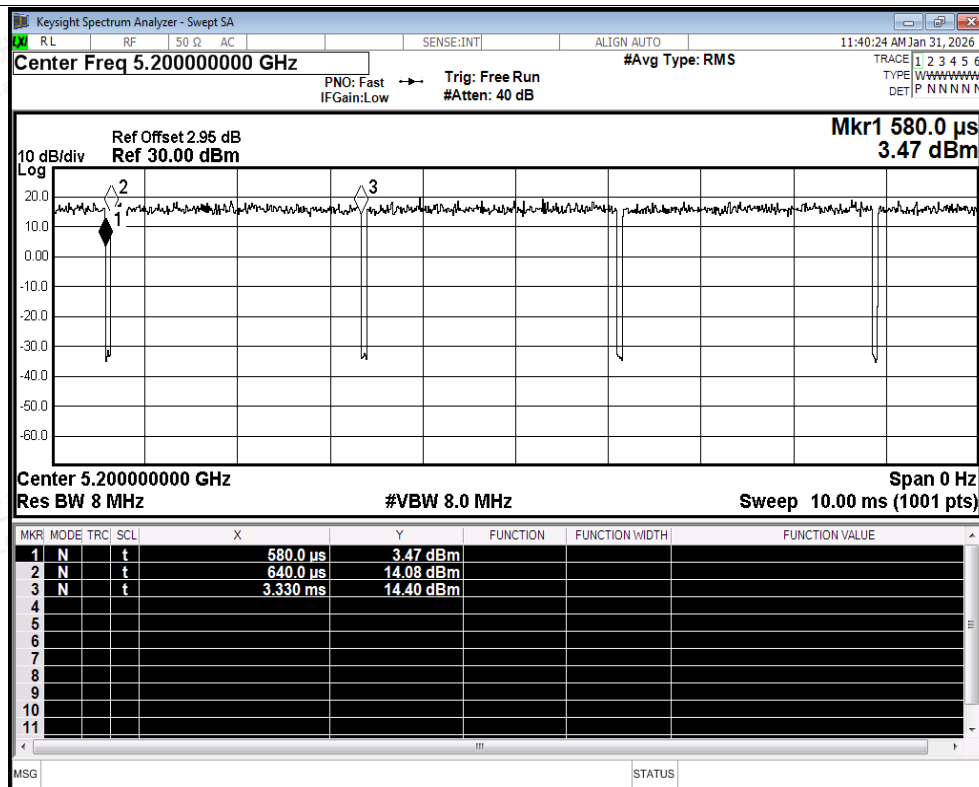

Duty Cycle NVNT a 5200MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

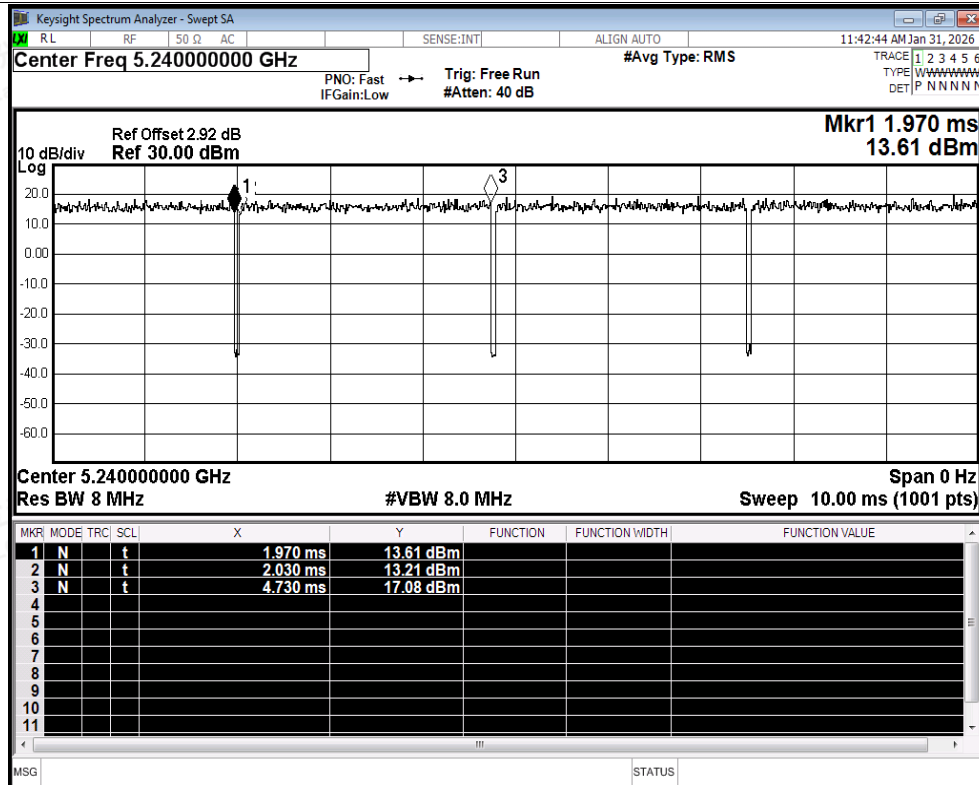

Duty Cycle NVNT a 5240MHz Ant2

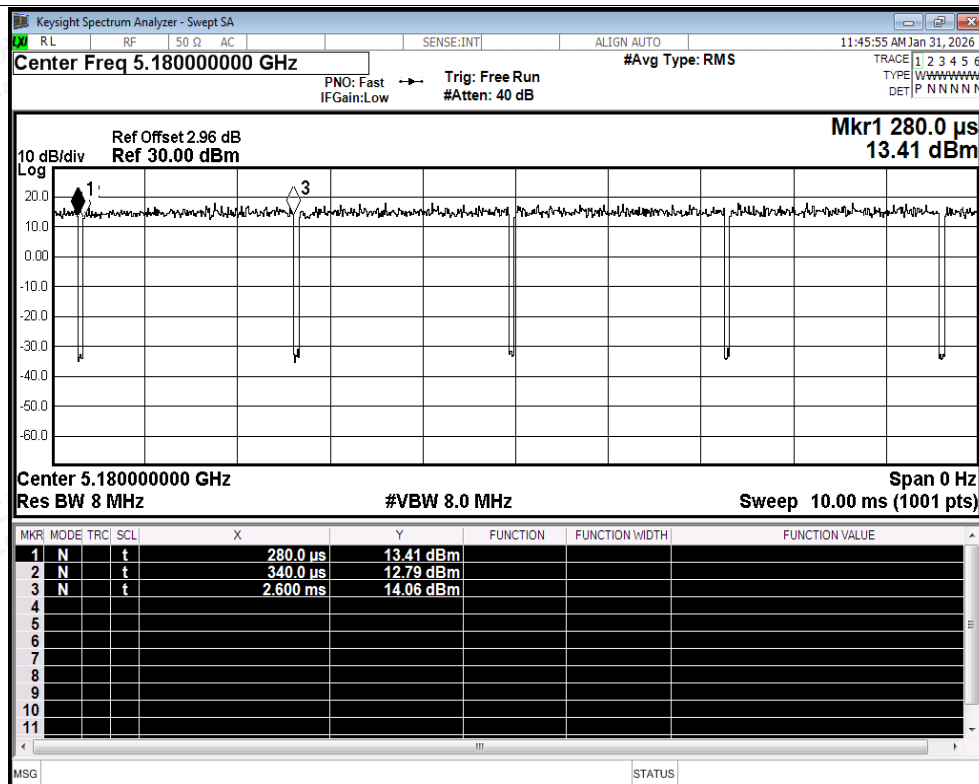

Duty Cycle NVNT n20 5180MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

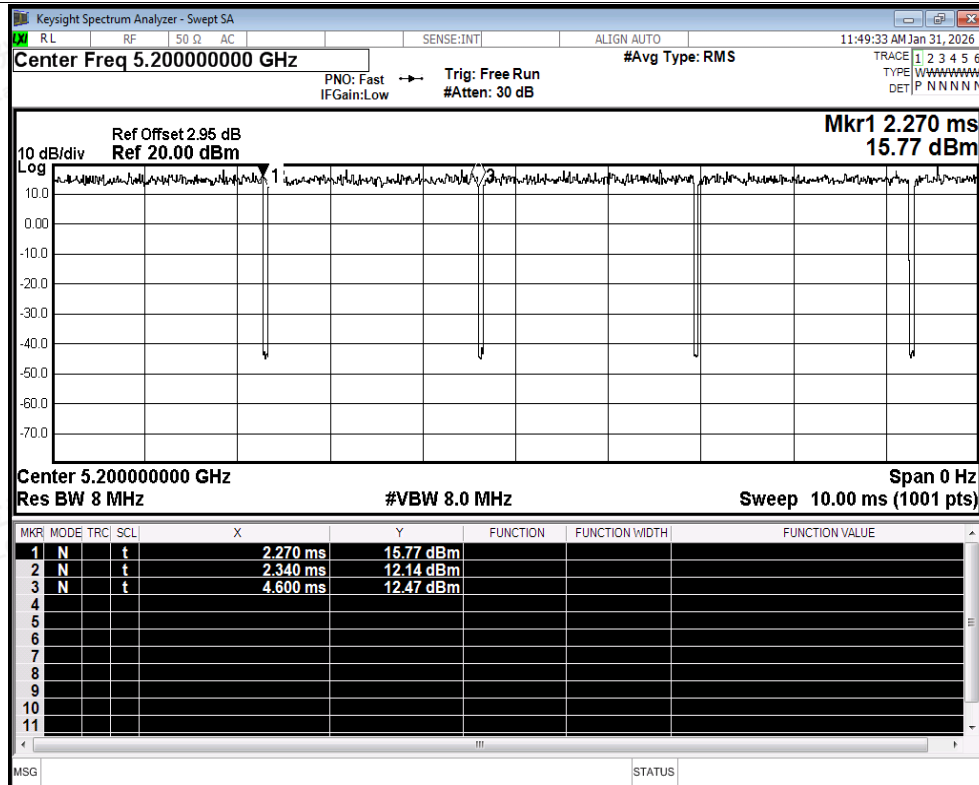


Duty Cycle NVNT n20 5200MHz Ant2

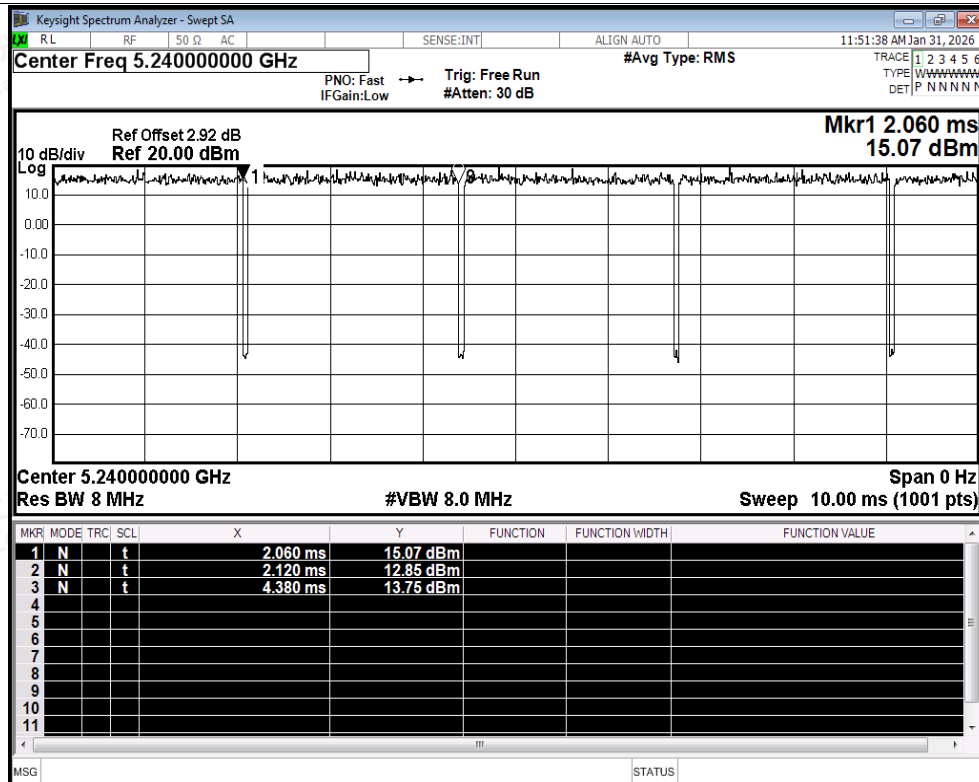


Duty Cycle NVNT n20 5240MHz Ant2



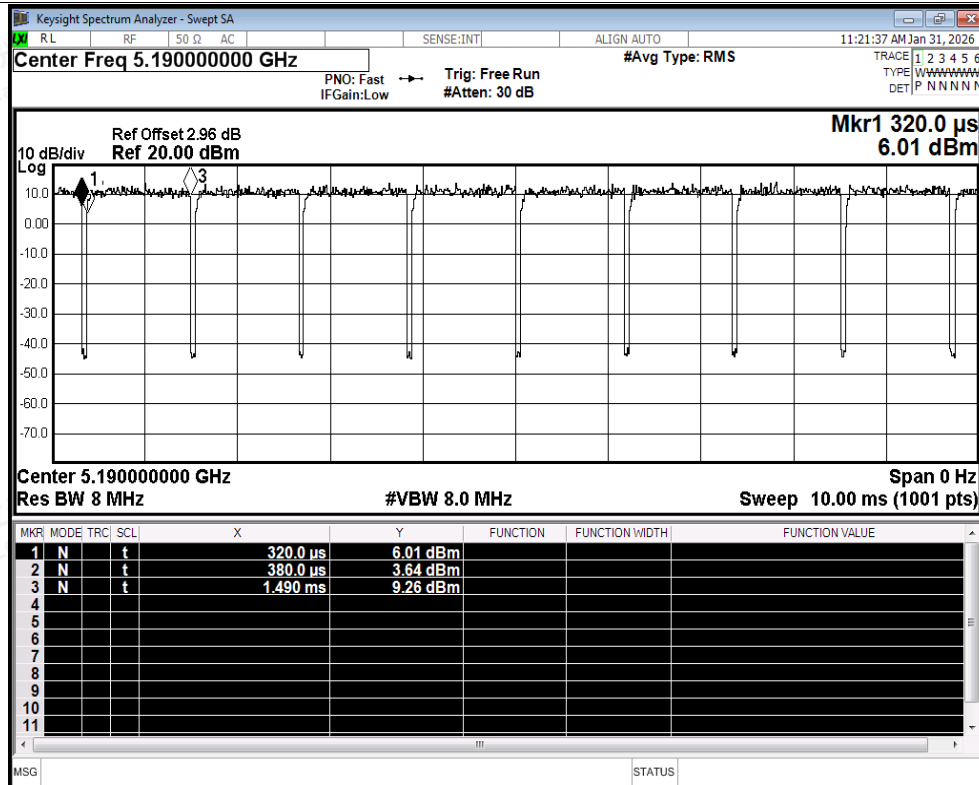

Duty Cycle NVNT n40 5190MHz Ant2

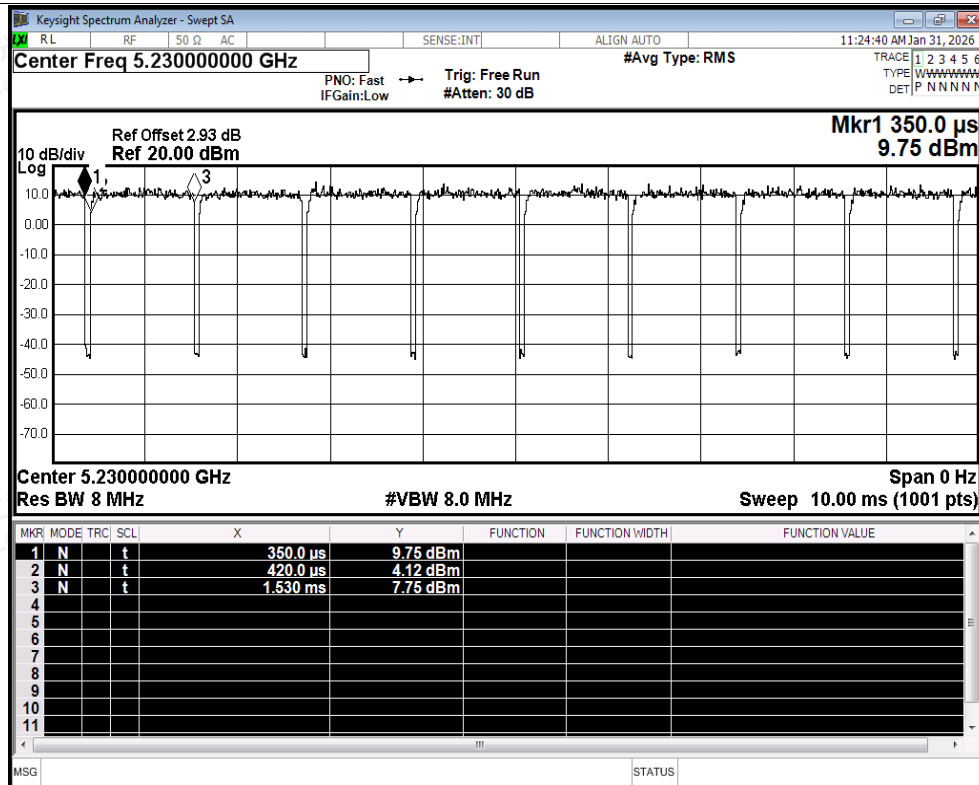

Duty Cycle NVNT n40 5230MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

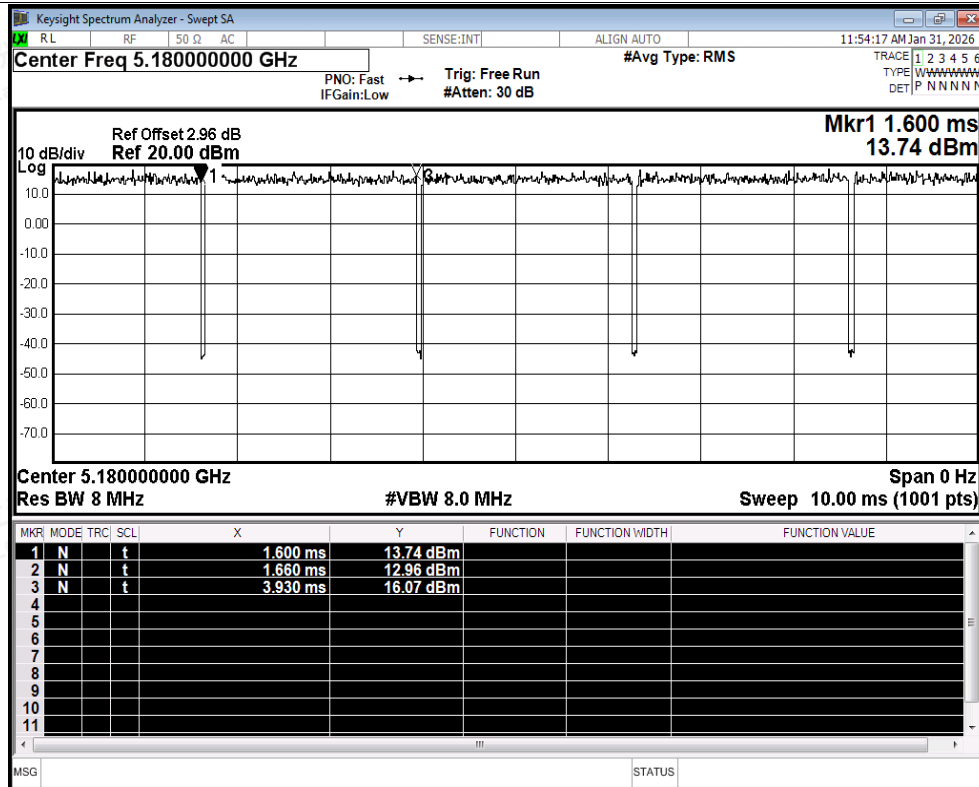

Duty Cycle NVNT ac20 5180MHz Ant2

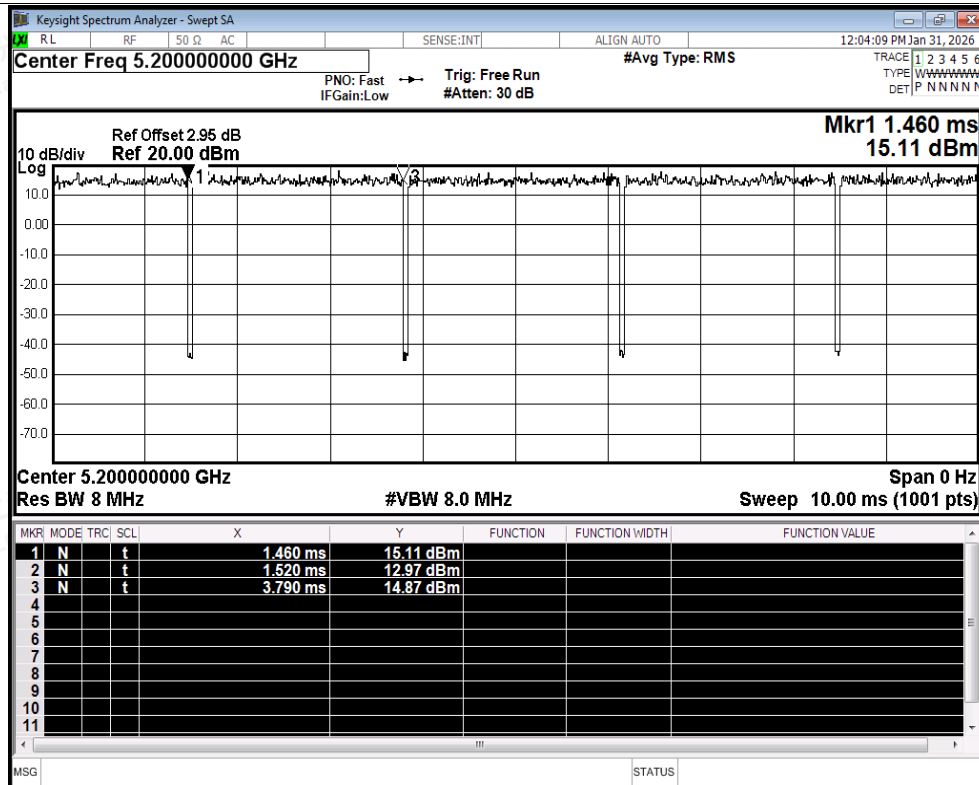

Duty Cycle NVNT ac20 5200MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

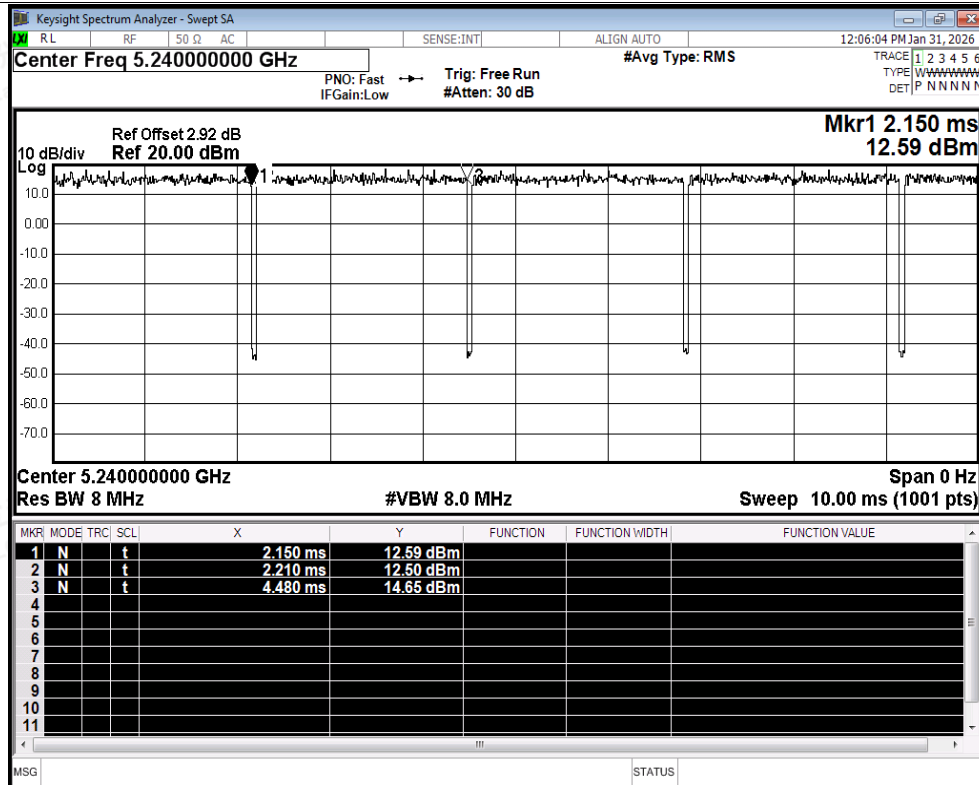


Duty Cycle NVNT ac20 5240MHz Ant2

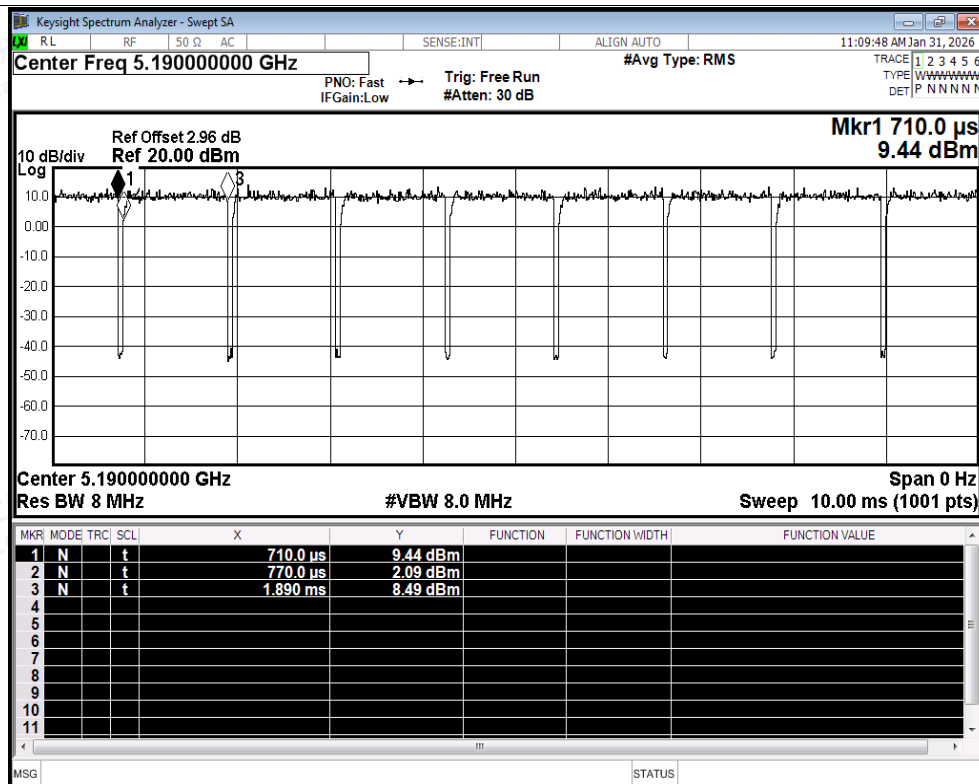


Duty Cycle NVNT ac40 5190MHz Ant2



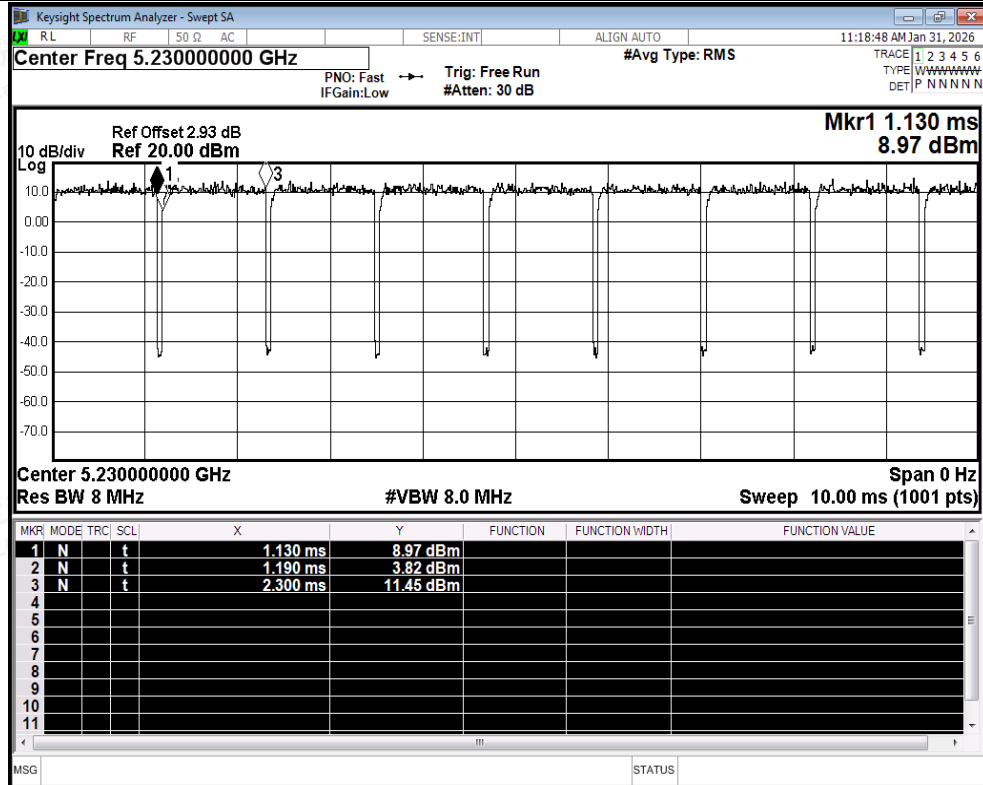

Duty Cycle NVNT ac40 5230MHz Ant2

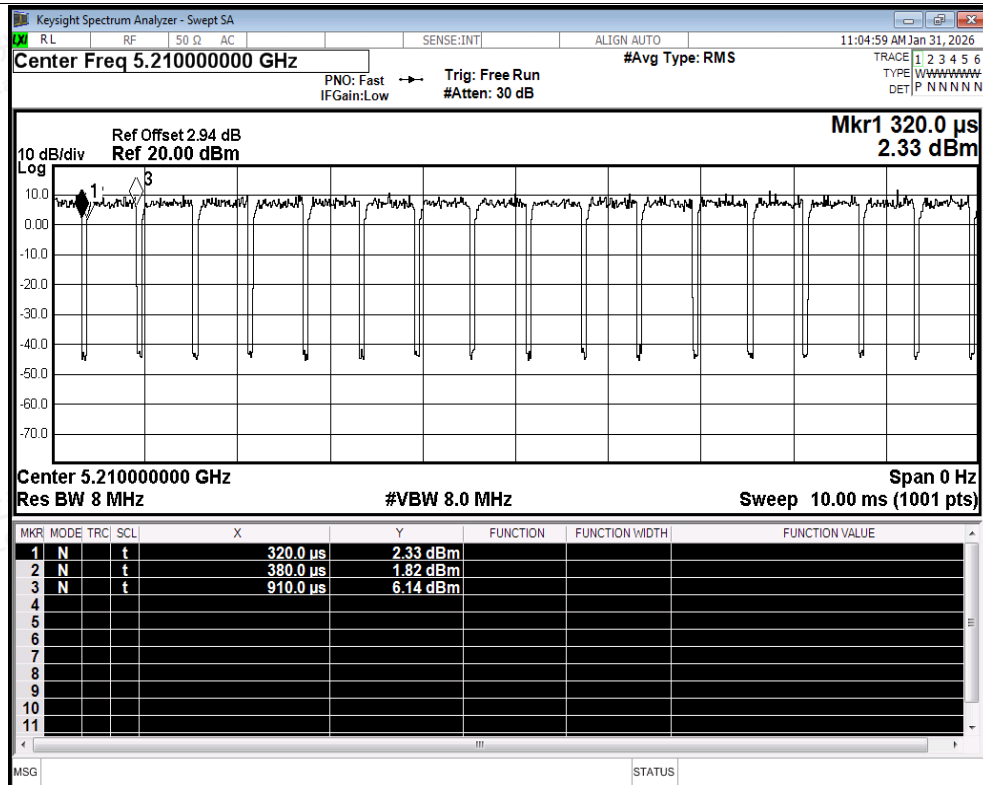

Duty Cycle NVNT ac80 5210MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

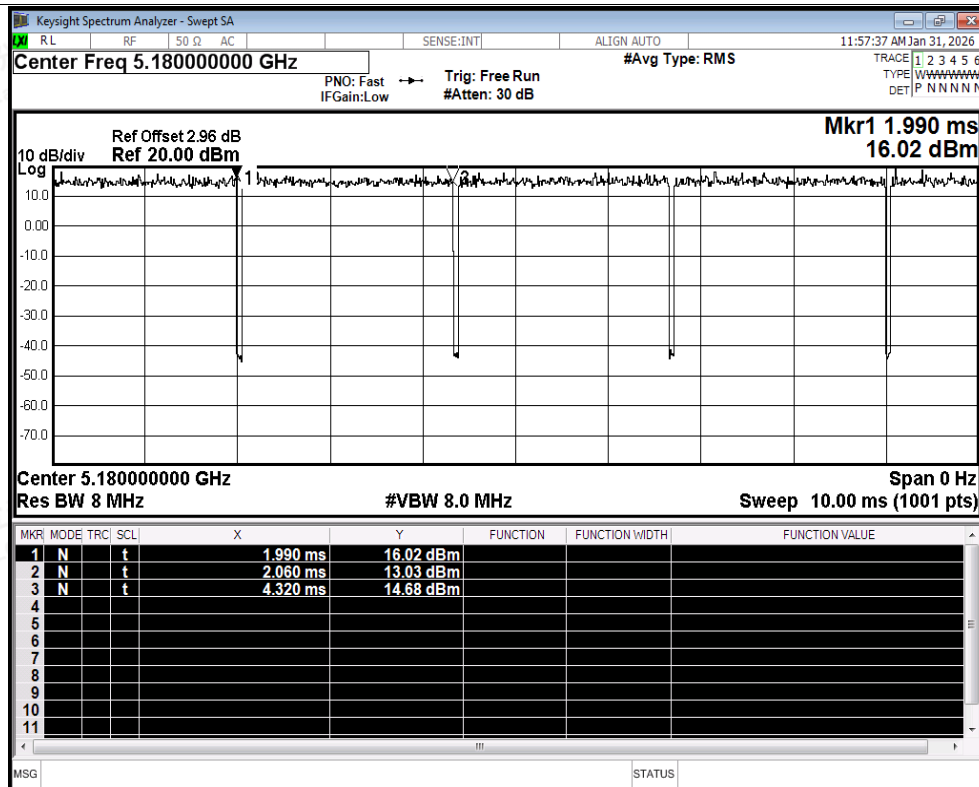

Duty Cycle NVNT ax20 5180MHz Ant2

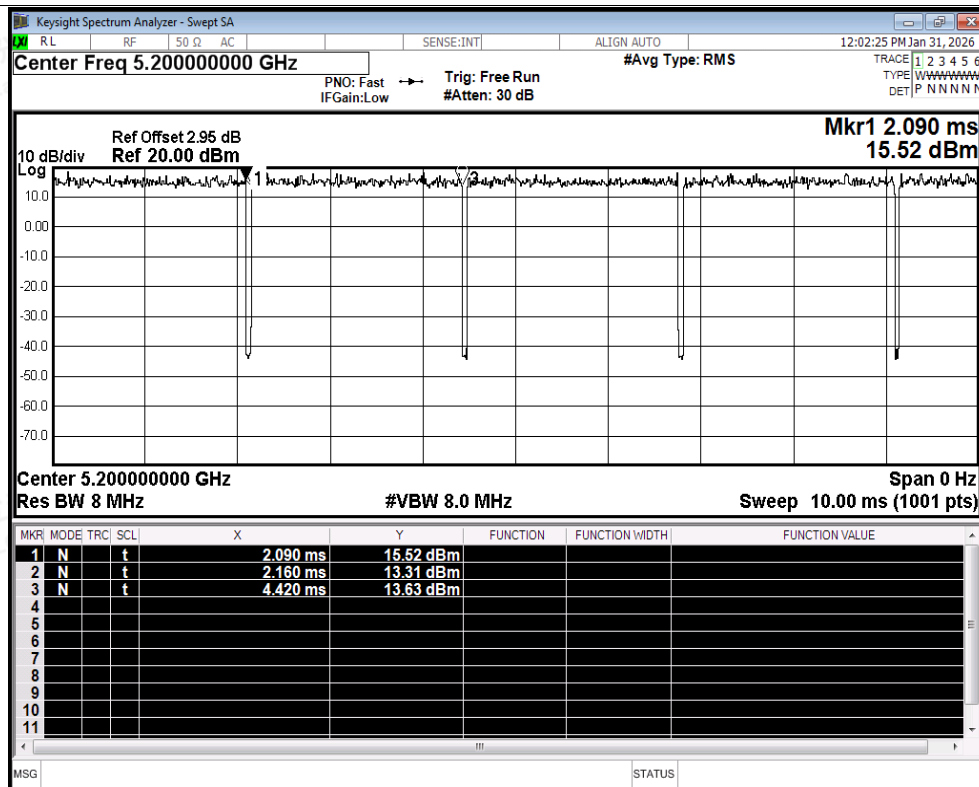

Duty Cycle NVNT ax20 5200MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

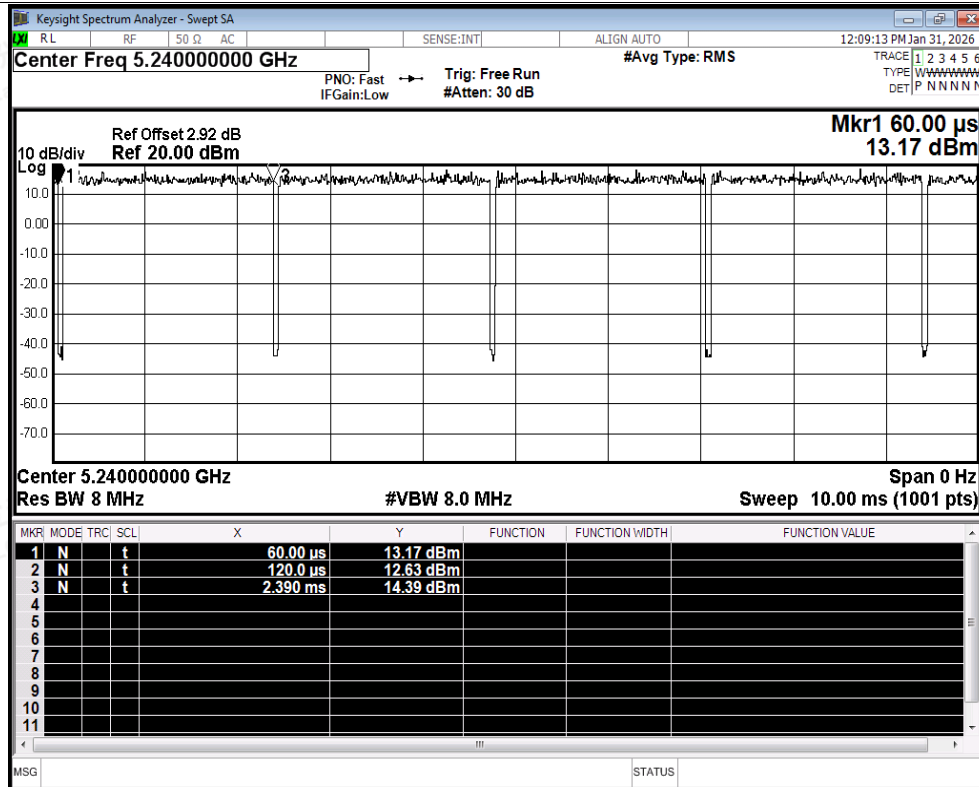

Duty Cycle NVNT ax20 5240MHz Ant2

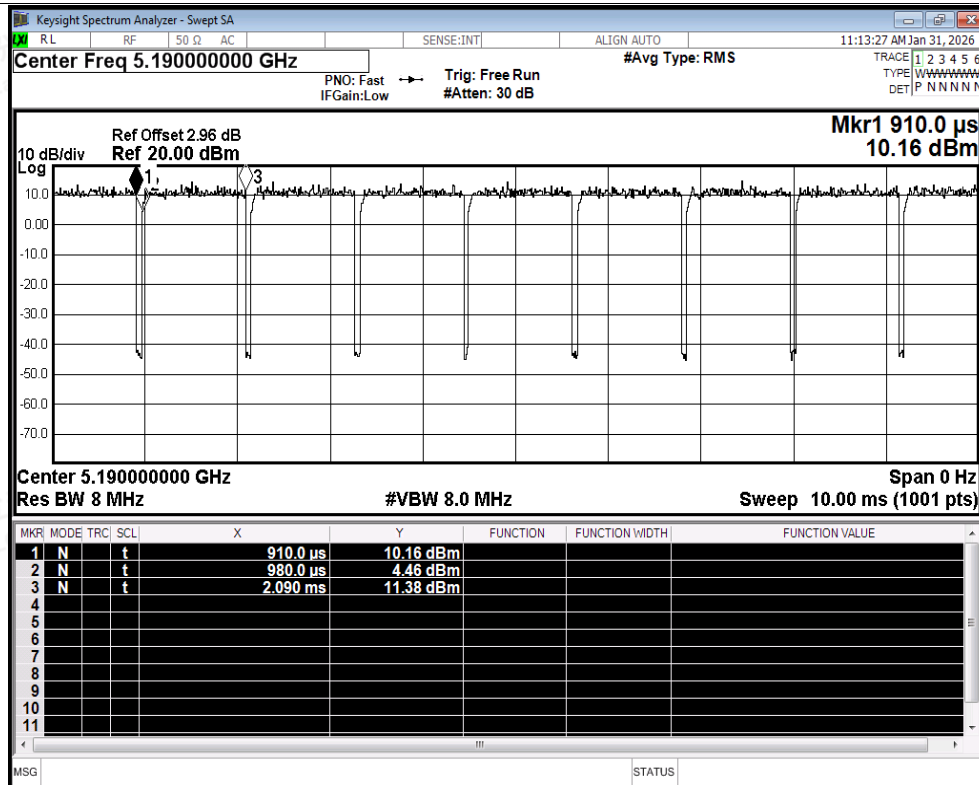

Duty Cycle NVNT ax40 5190MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

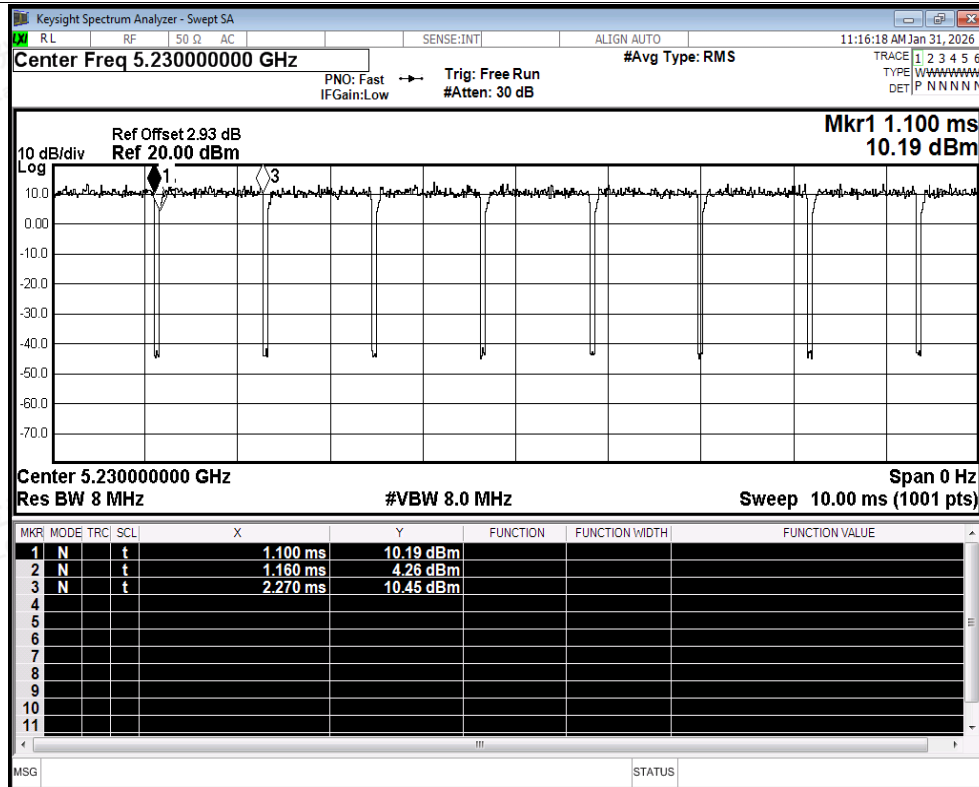

Duty Cycle NVNT ax40 5230MHz Ant2

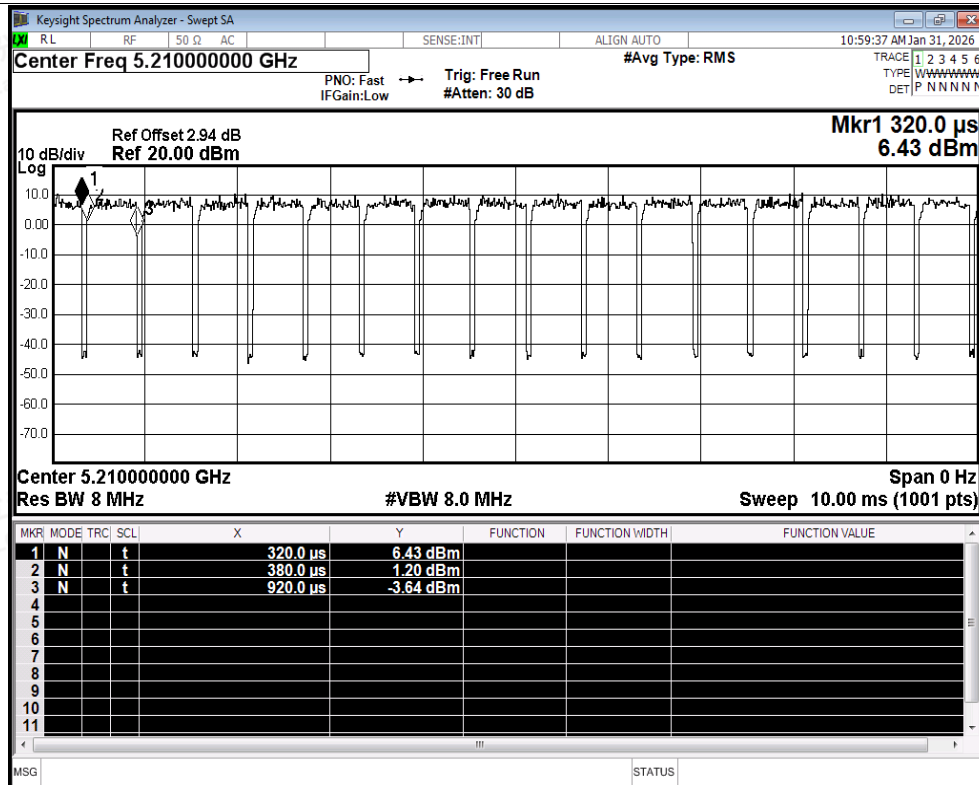

Duty Cycle NVNT ax80 5210MHz Ant2



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity