



NVNT	ax40	5270	Ant2	4500	-49.8	5.58	51.01	Peak	68.2	Pass
NVNT	ax40	5270	Ant2	4500	-58.97	5.58	41.84	Average	54	Pass
NVNT	ax40	5270	Ant2	4807.8	-46.18	5.58	54.63	Peak	68.2	Pass
NVNT	ax40	5270	Ant2	4806.99	-51.35	5.58	49.46	Average	54	Pass
NVNT	ax40	5270	Ant2	5150	-49.4	5.58	51.41	Peak	68.2	Pass
NVNT	ax40	5270	Ant2	5150	-56.71	5.58	44.10	Average	54	Pass
NVNT	ax40	5310	Ant2	5350	-35.5	5.58	65.31	Peak	68.2	Pass
NVNT	ax40	5310	Ant2	5350	-47.83	5.58	52.98	Average	54	Pass
NVNT	ax40	5310	Ant2	5351.4	-34.48	5.58	66.33	Peak	68.2	Pass
NVNT	ax40	5310	Ant2	5350	-47.83	5.58	52.98	Average	54	Pass
NVNT	ax40	5310	Ant2	5460	-49.08	5.58	51.73	Peak	68.2	Pass
NVNT	ax40	5310	Ant2	5460	-57.27	5.58	43.54	Average	54	Pass
NVNT	ax80	5290	Ant2	5350	-39.33	5.58	61.48	Peak	68.2	Pass
NVNT	ax80	5290	Ant2	5350	-53.48	5.58	47.33	Average	54	Pass
NVNT	ax80	5290	Ant2	5350	-39.33	5.58	61.48	Peak	68.2	Pass
NVNT	ax80	5290	Ant2	5350	-53.48	5.58	47.33	Average	54	Pass
NVNT	ax80	5290	Ant2	5460	-50.77	5.58	50.04	Peak	68.2	Pass
NVNT	ax80	5290	Ant2	5460	-57.01	5.58	43.80	Average	54	Pass
NVNT	ax80	5290	Ant2	4500	-51.41	5.58	49.40	Peak	68.2	Pass
NVNT	ax80	5290	Ant2	4500	-58.77	5.58	42.04	Average	54	Pass
NVNT	ax80	5290	Ant2	5134.23	-46.62	5.58	54.19	Peak	68.2	Pass
NVNT	ax80	5290	Ant2	5024.61	-56.14	5.58	44.67	Average	54	Pass
NVNT	ax80	5290	Ant2	5150	-50.86	5.58	49.95	Peak	68.2	Pass
NVNT	ax80	5290	Ant2	5150	-56.79	5.58	44.02	Average	54	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

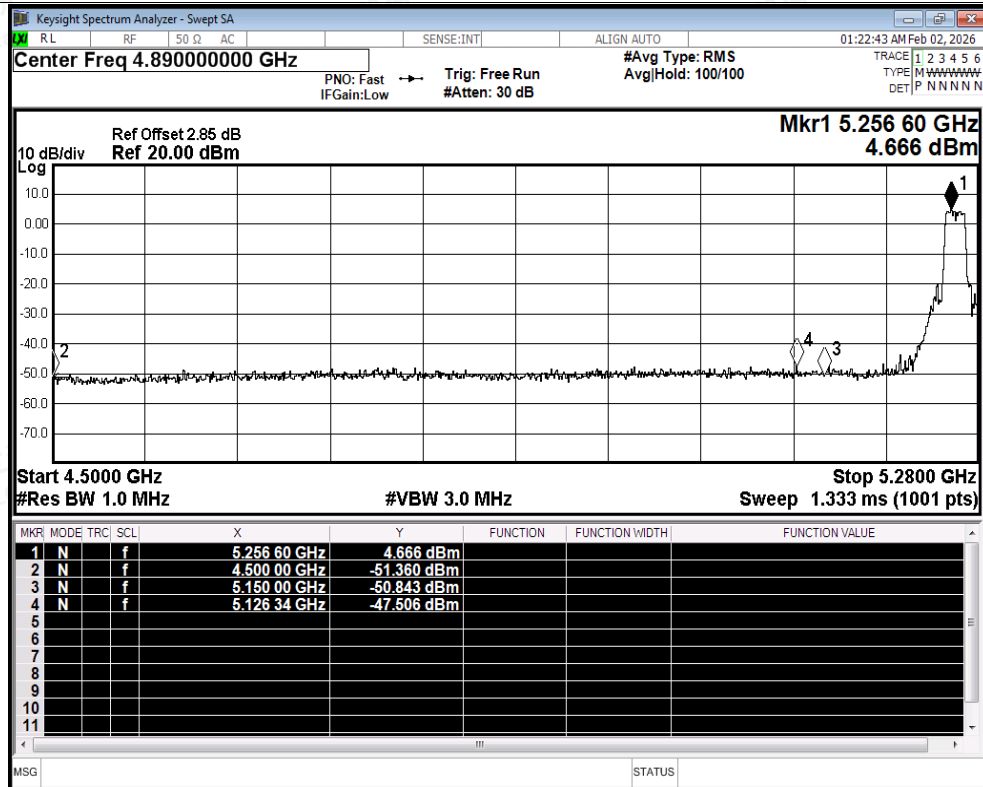

Restrict Band NVNT a 5260MHz Ant2 Peak

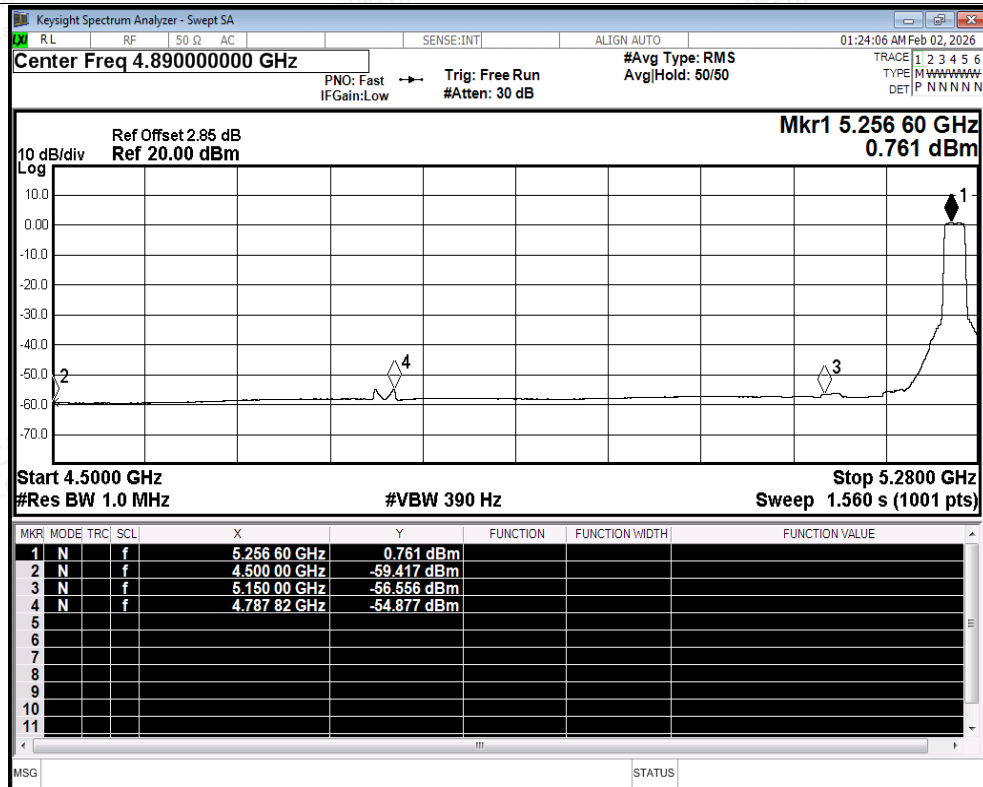

Restrict Band NVNT a 5260MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

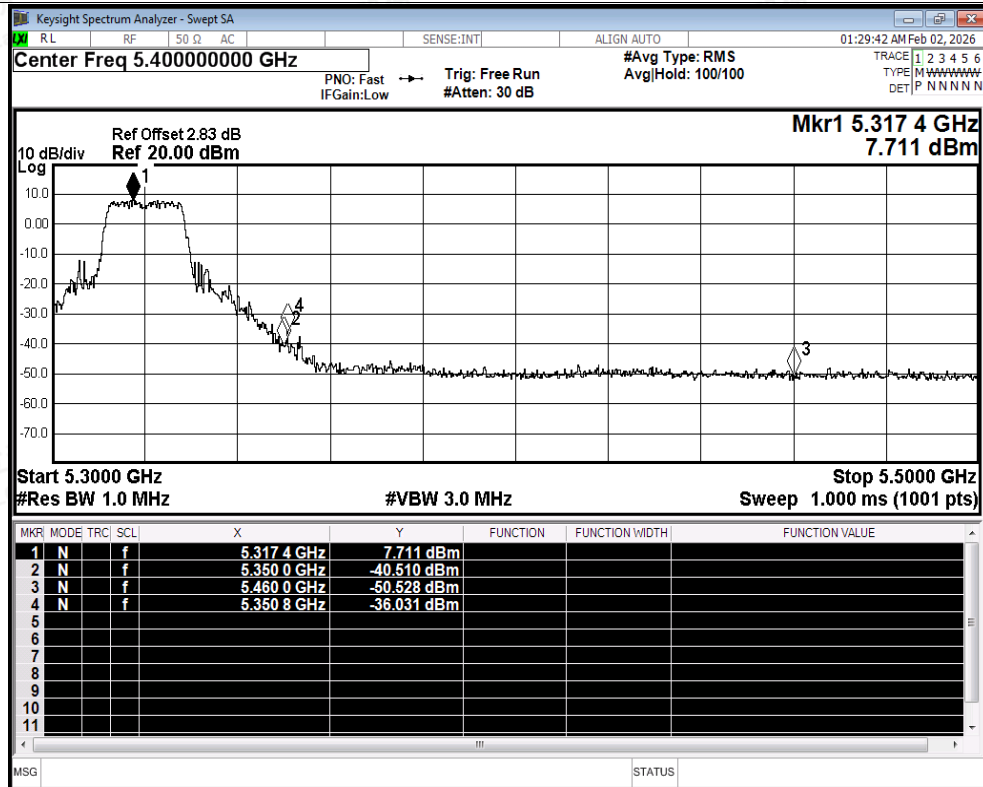

Restrict Band NVNT a 5320MHz Ant2 Peak

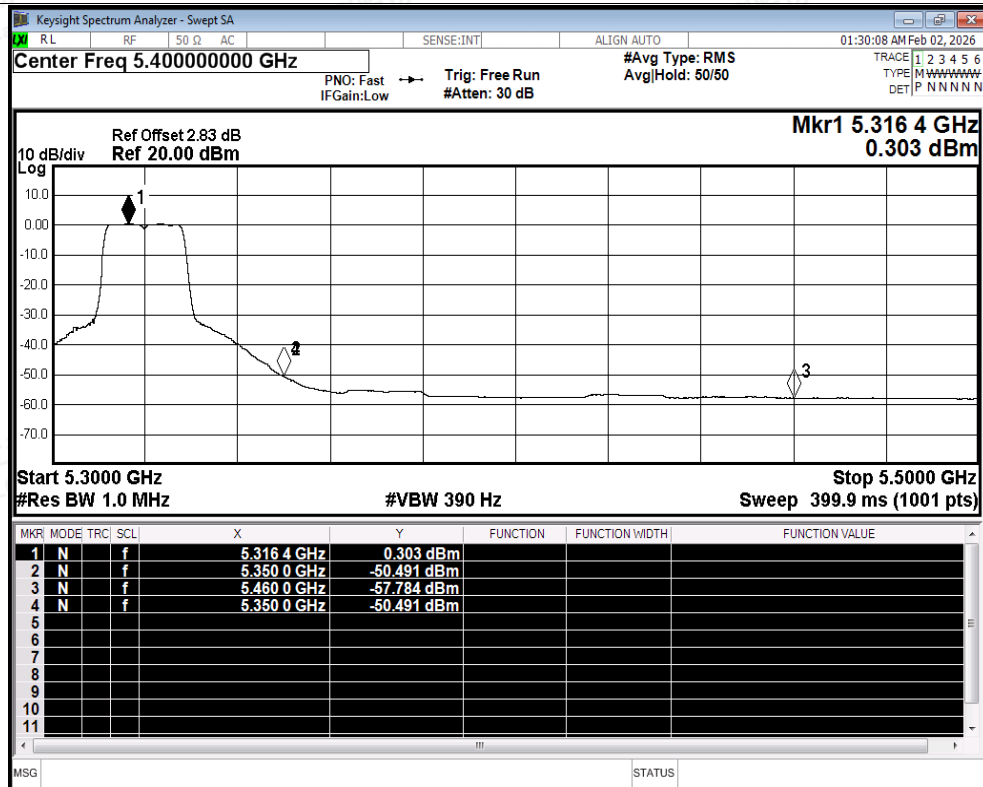

Restrict Band NVNT a 5320MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

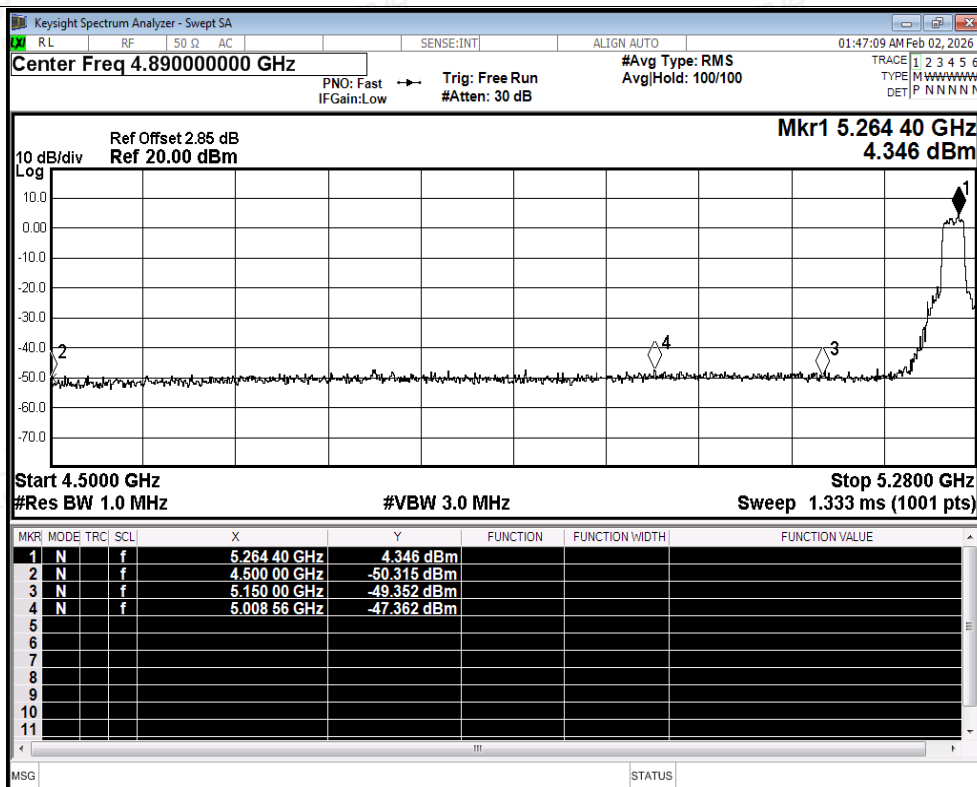

Restrict Band NVNT n20 5260MHz Ant2 Peak

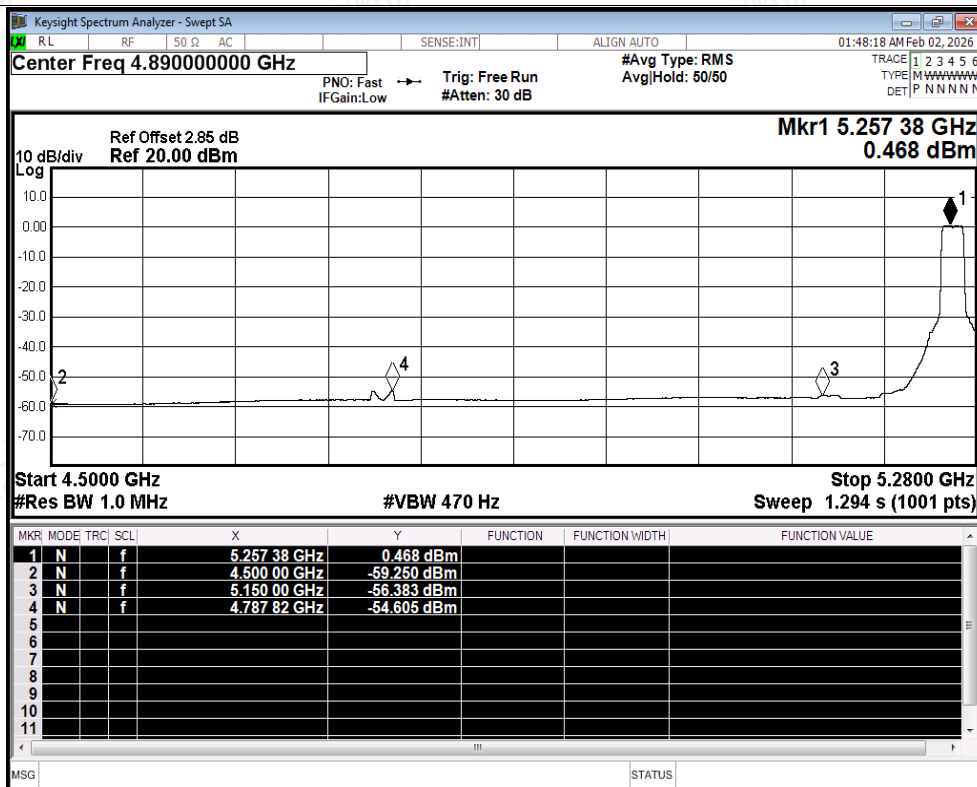

Restrict Band NVNT n20 5260MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

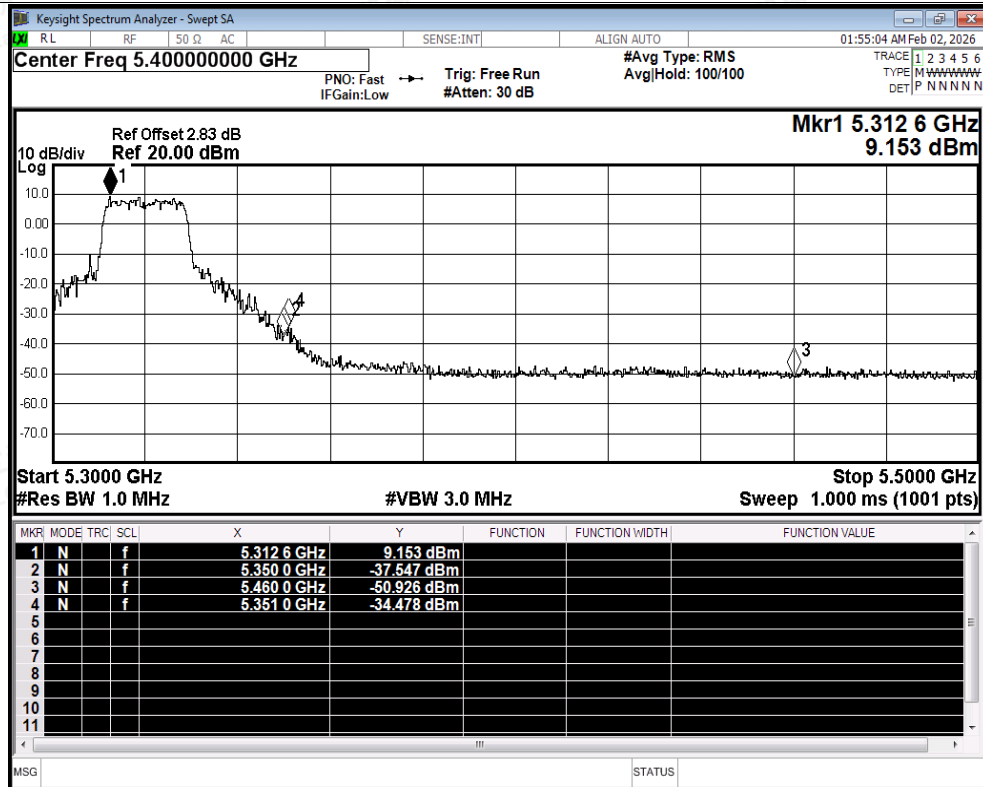

Restrict Band NVNT n20 5320MHz Ant2 Peak

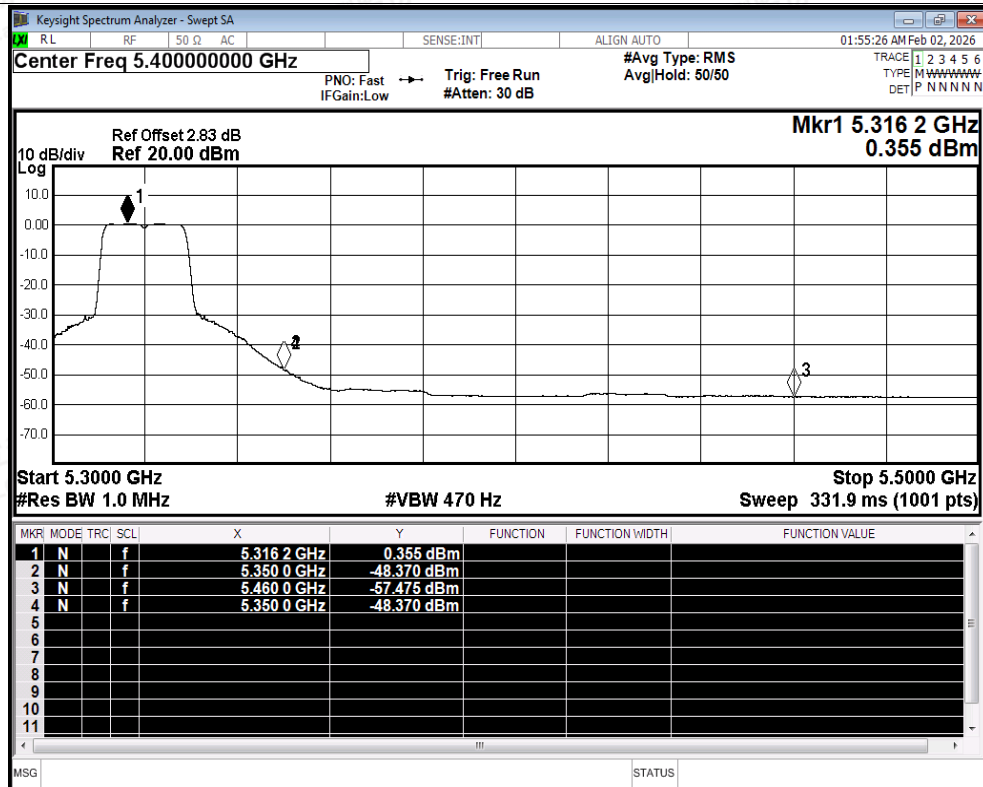

Restrict Band NVNT n20 5320MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

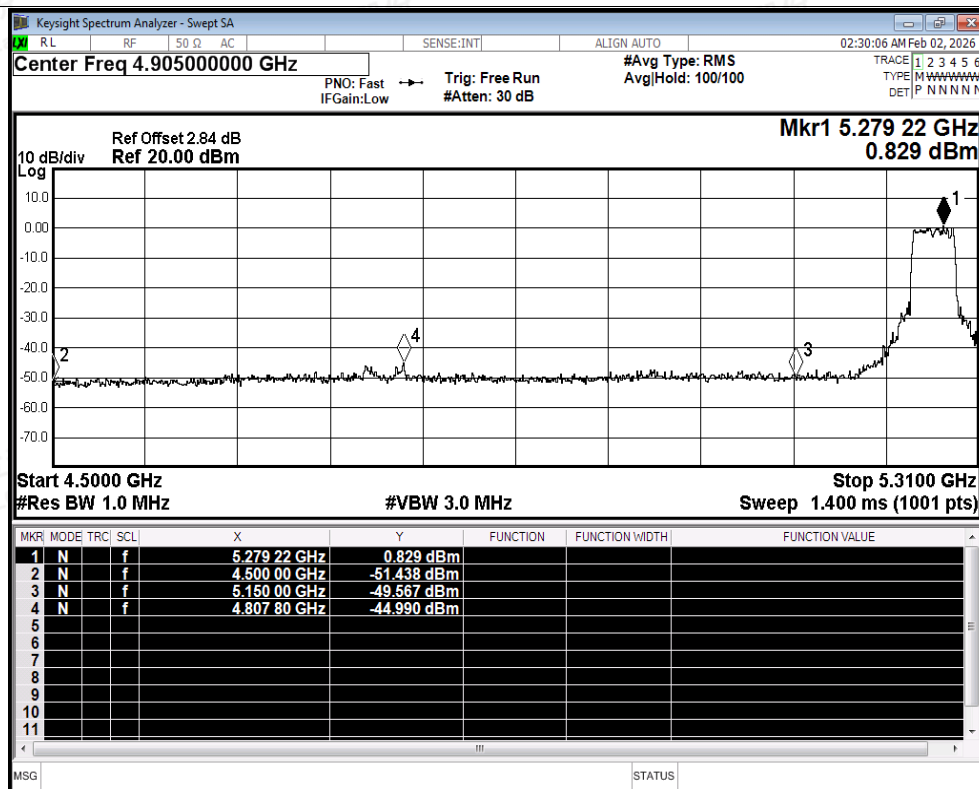

Restrict Band NVNT n40 5270MHz Ant2 Peak

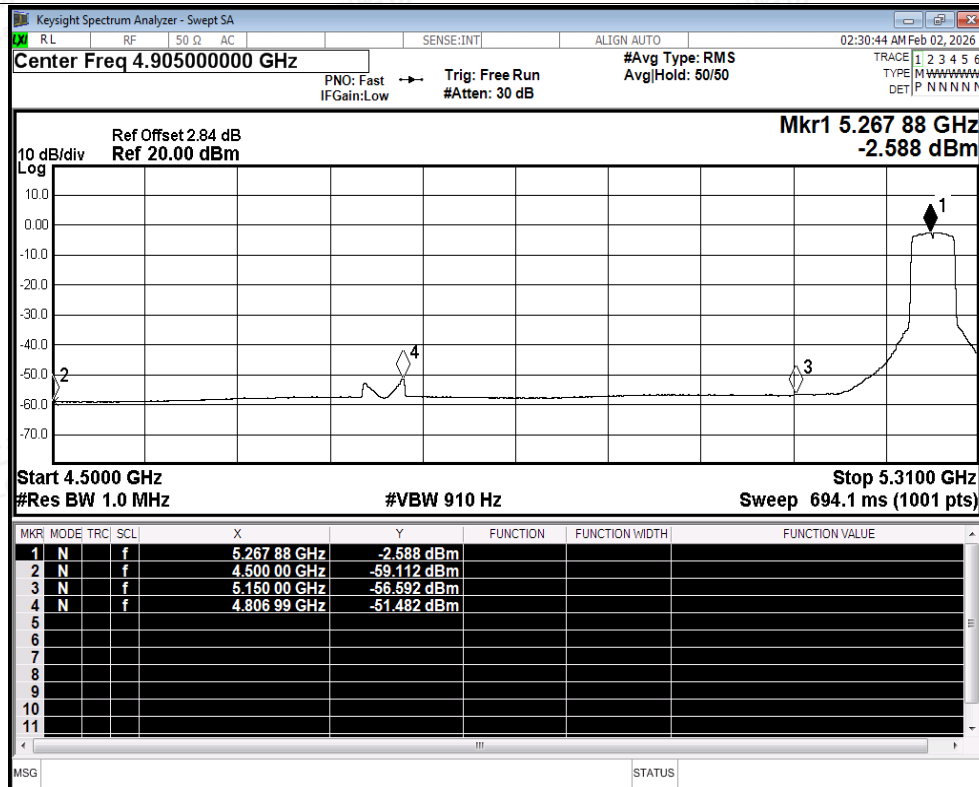

Restrict Band NVNT n40 5270MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

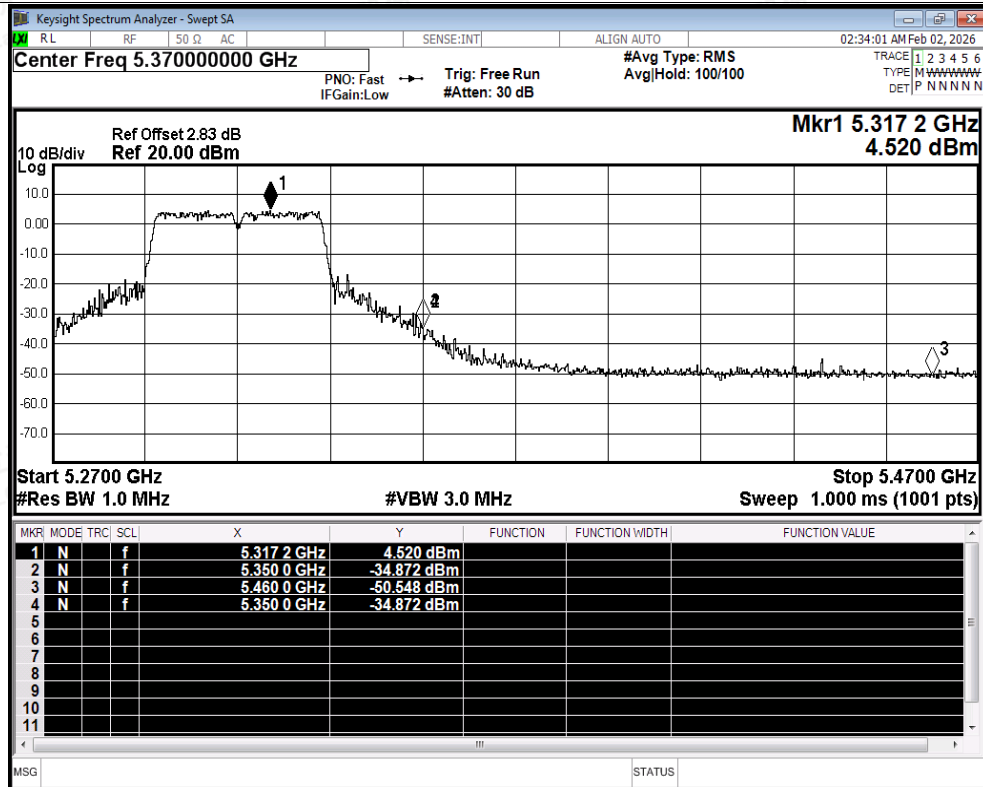

Restrict Band NVNT n40 5310MHz Ant2 Peak

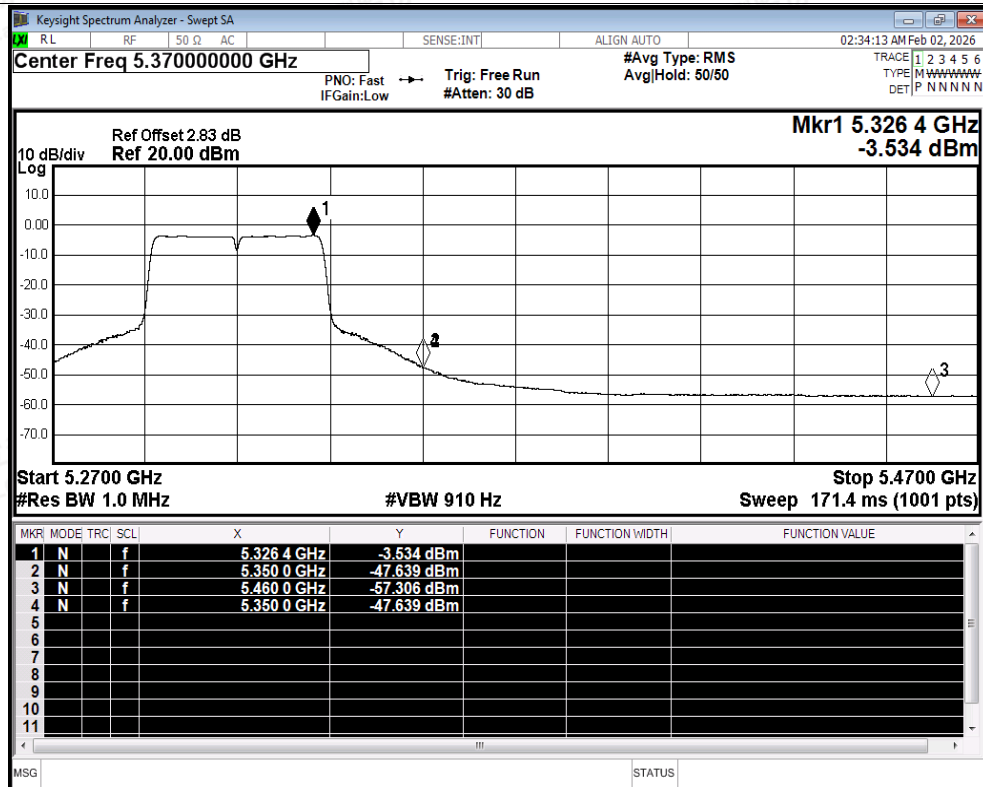

Restrict Band NVNT n40 5310MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

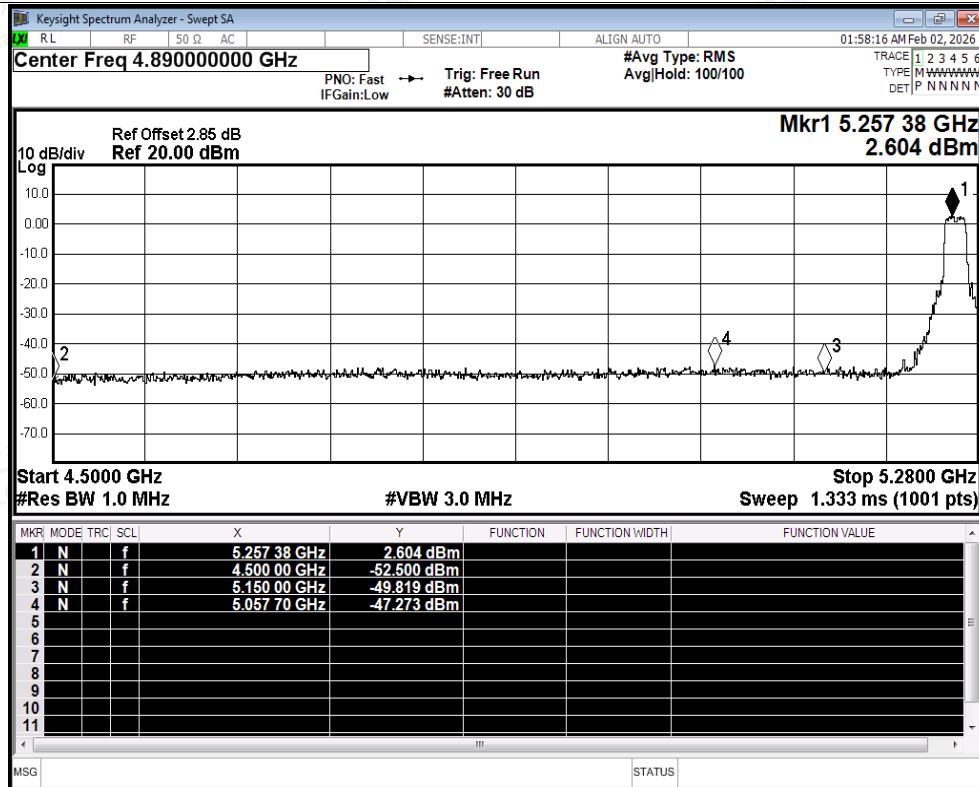

Restrict Band NVNT ac20 5260MHz Ant2 Peak

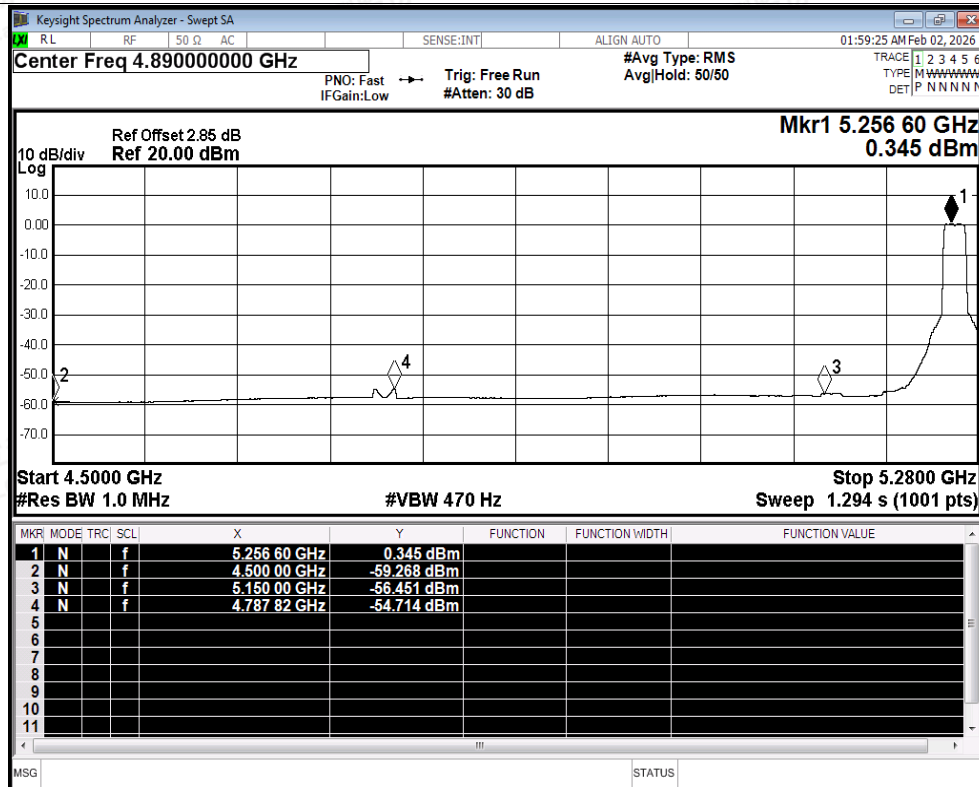

Restrict Band NVNT ac20 5260MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

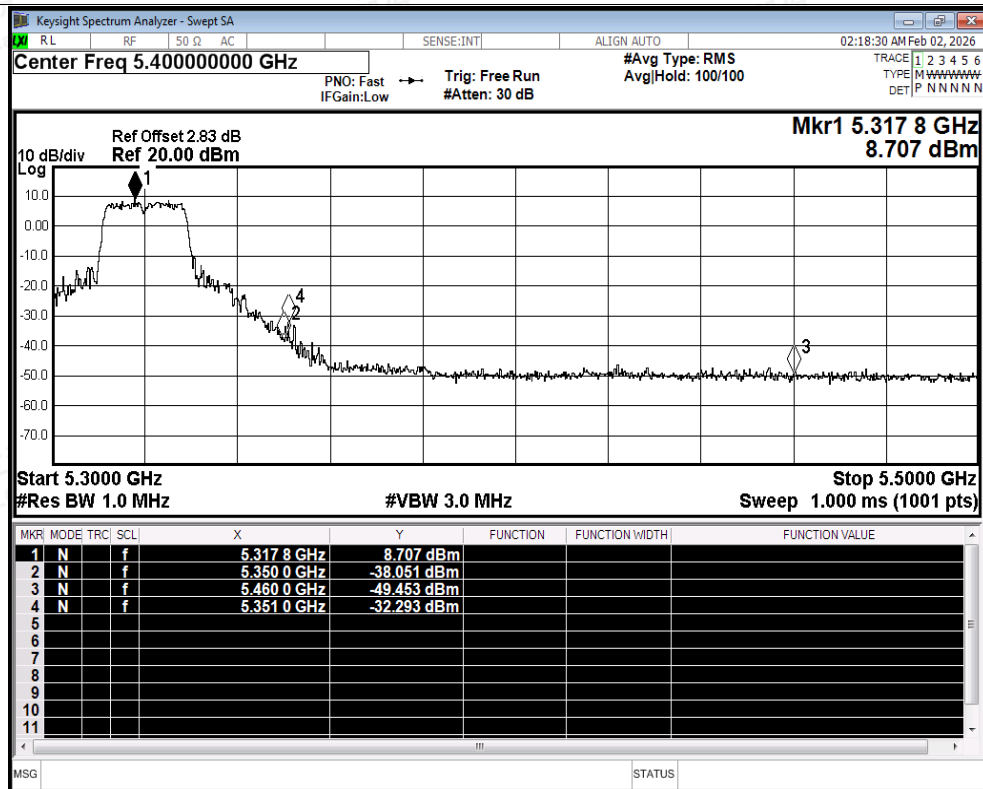

Restrict Band NVNT ac20 5320MHz Ant2 Peak

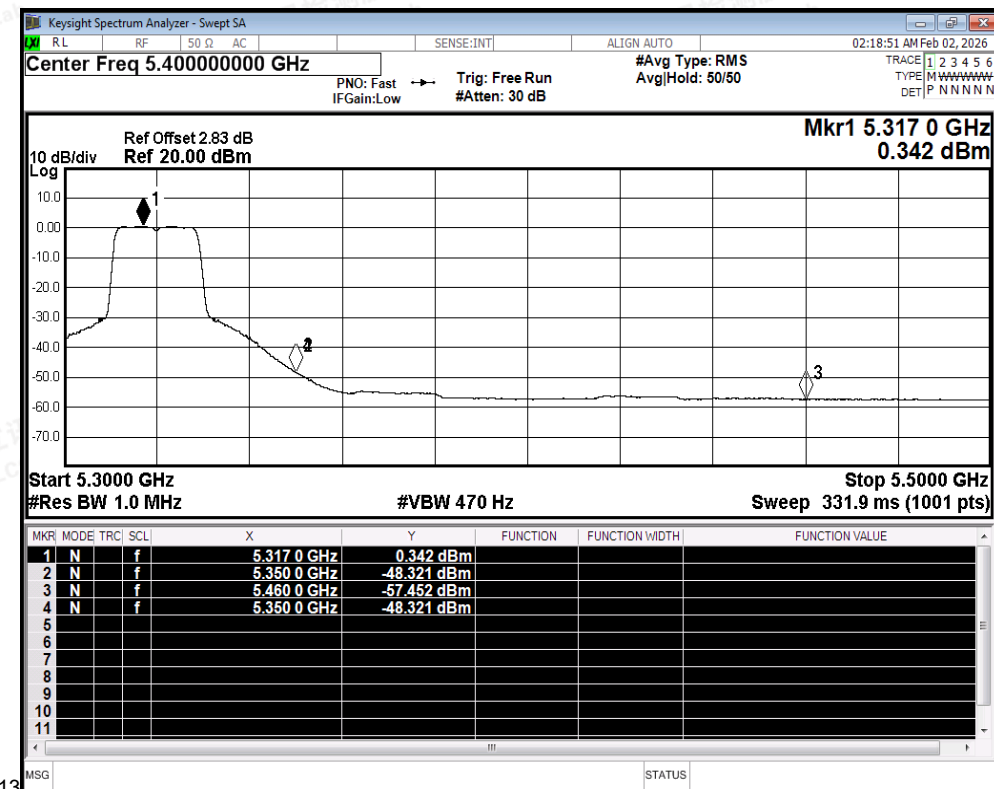

Restrict Band NVNT ac20 5320MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

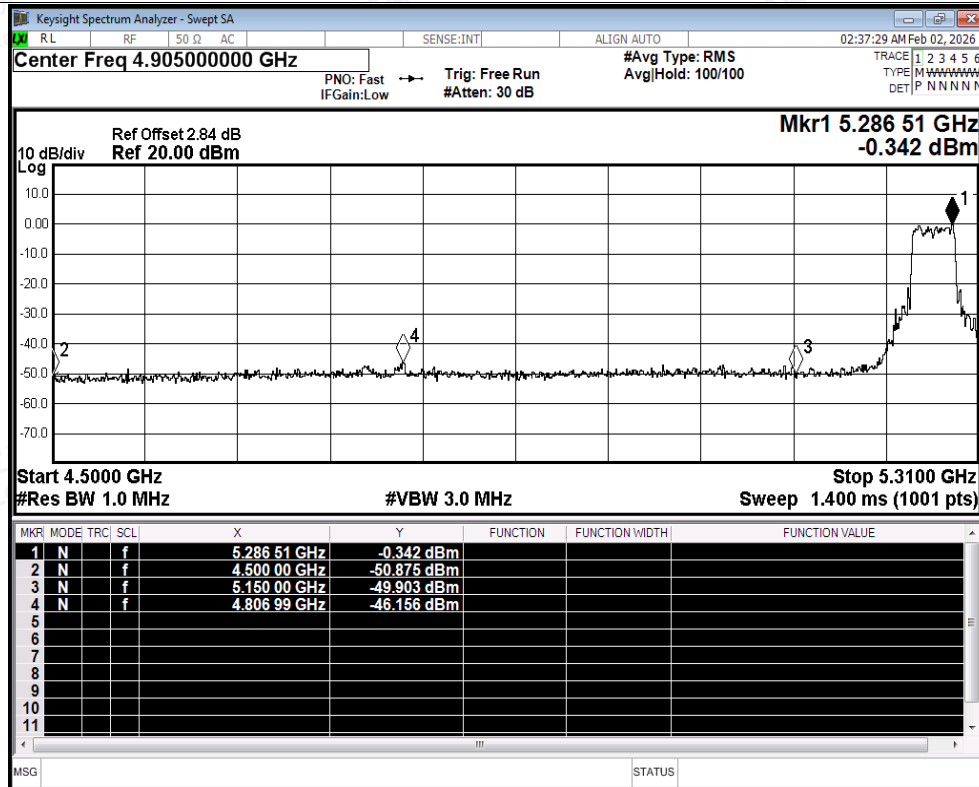

Restrict Band NVNT ac40 5270MHz Ant2 Peak

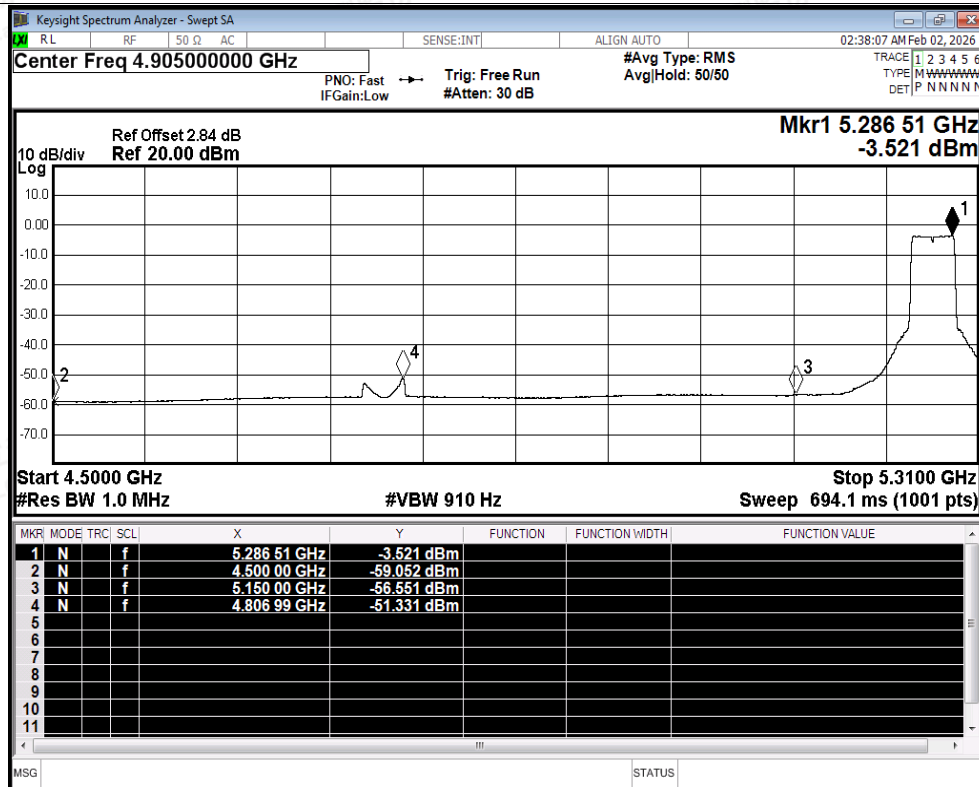

Restrict Band NVNT ac40 5270MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

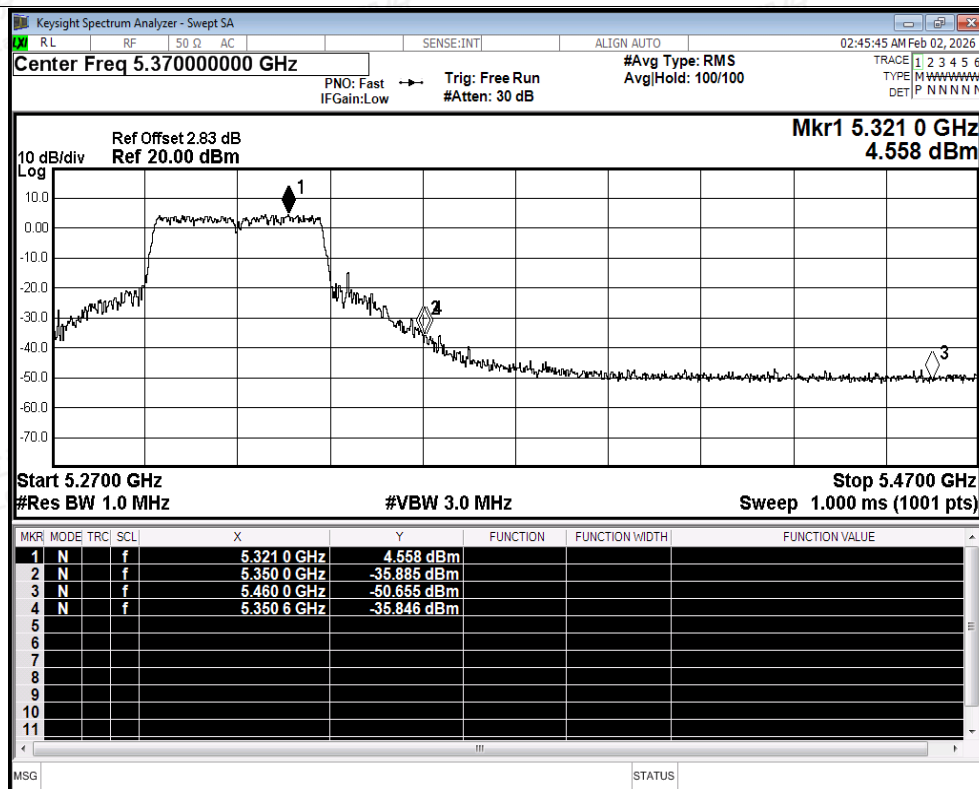

Restrict Band NVNT ac40 5310MHz Ant2 Peak

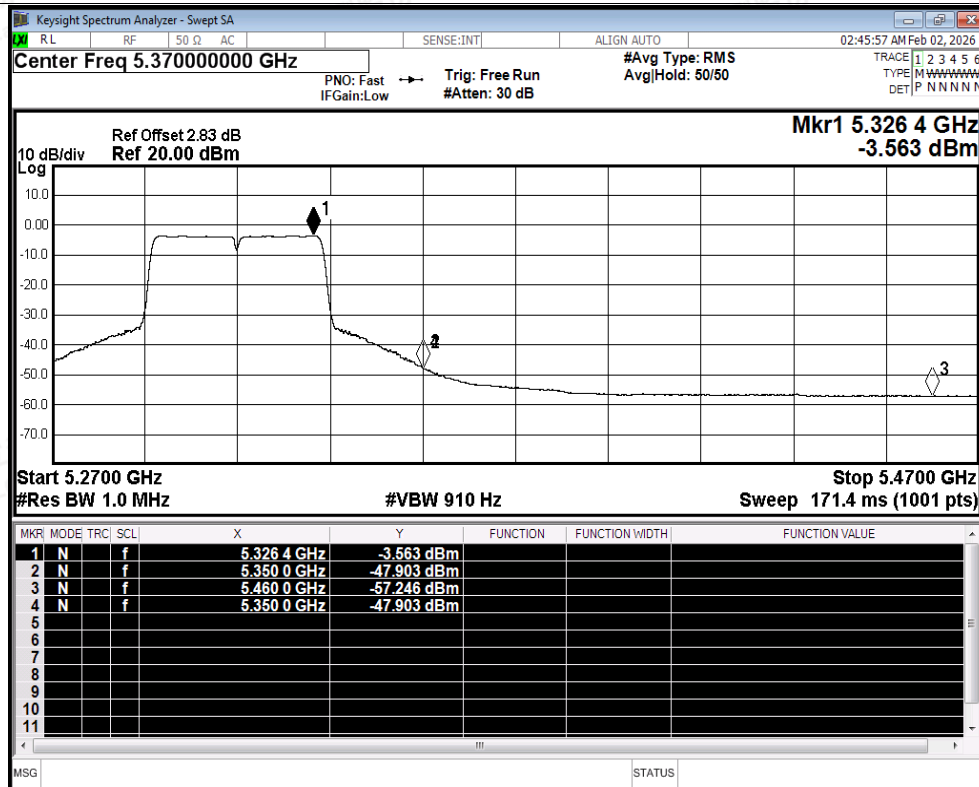

Restrict Band NVNT ac40 5310MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

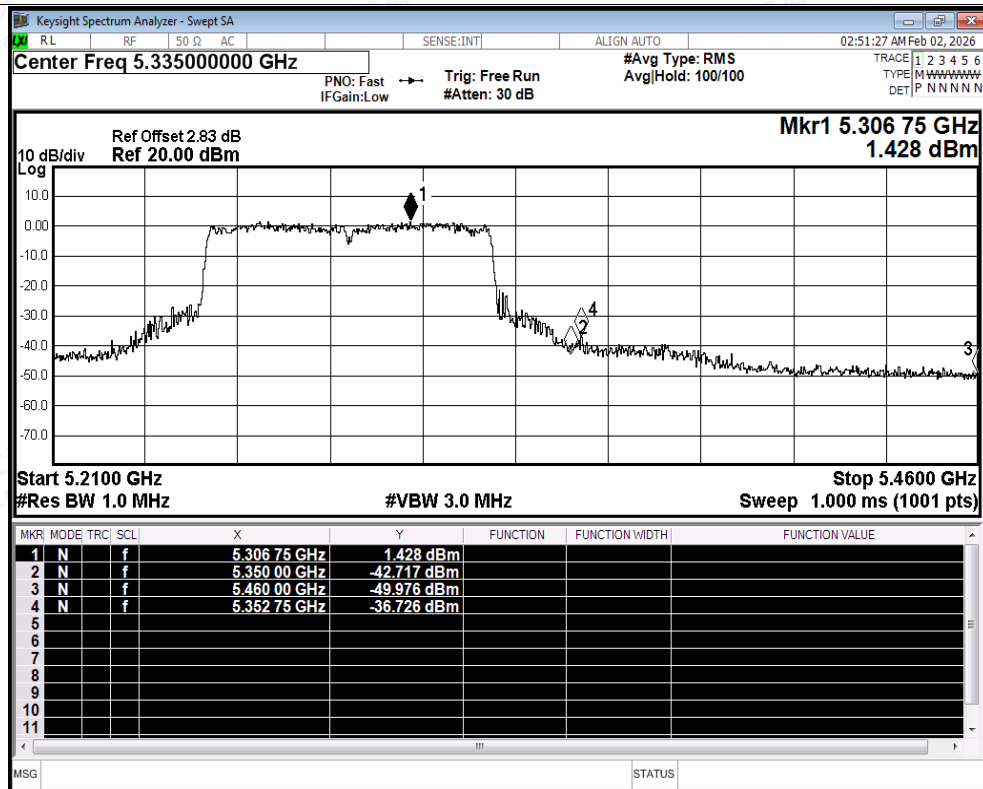

Restrict Band NVNT ac80 5290MHz Ant2 Peak

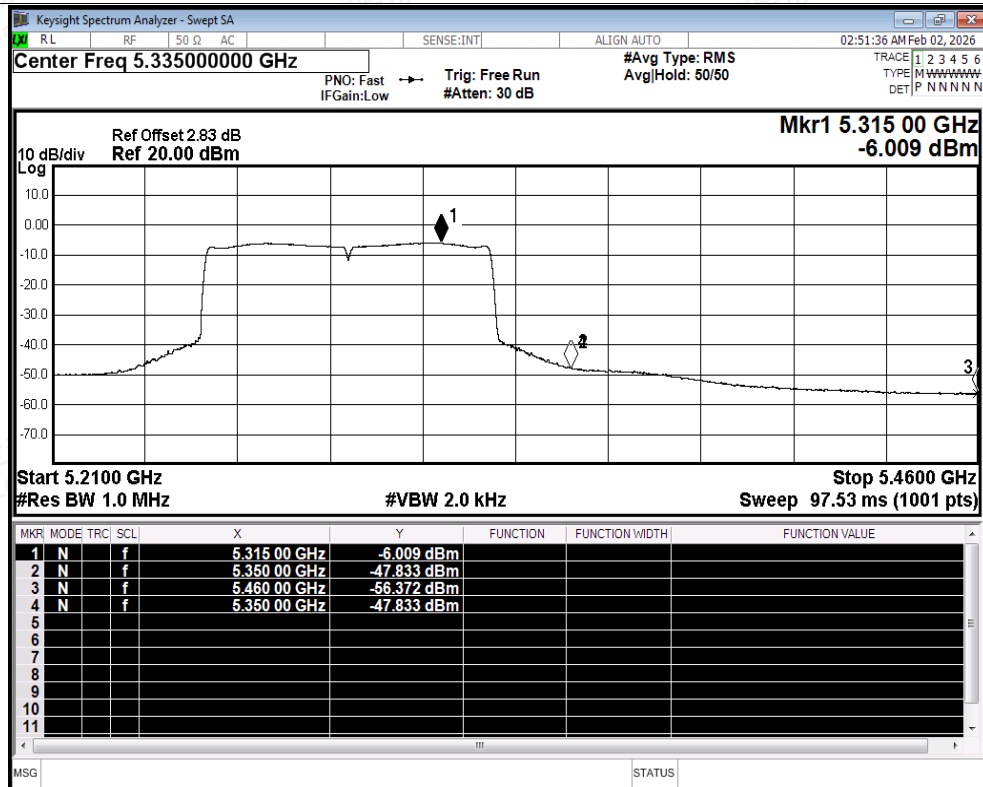

Restrict Band NVNT ac80 5290MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

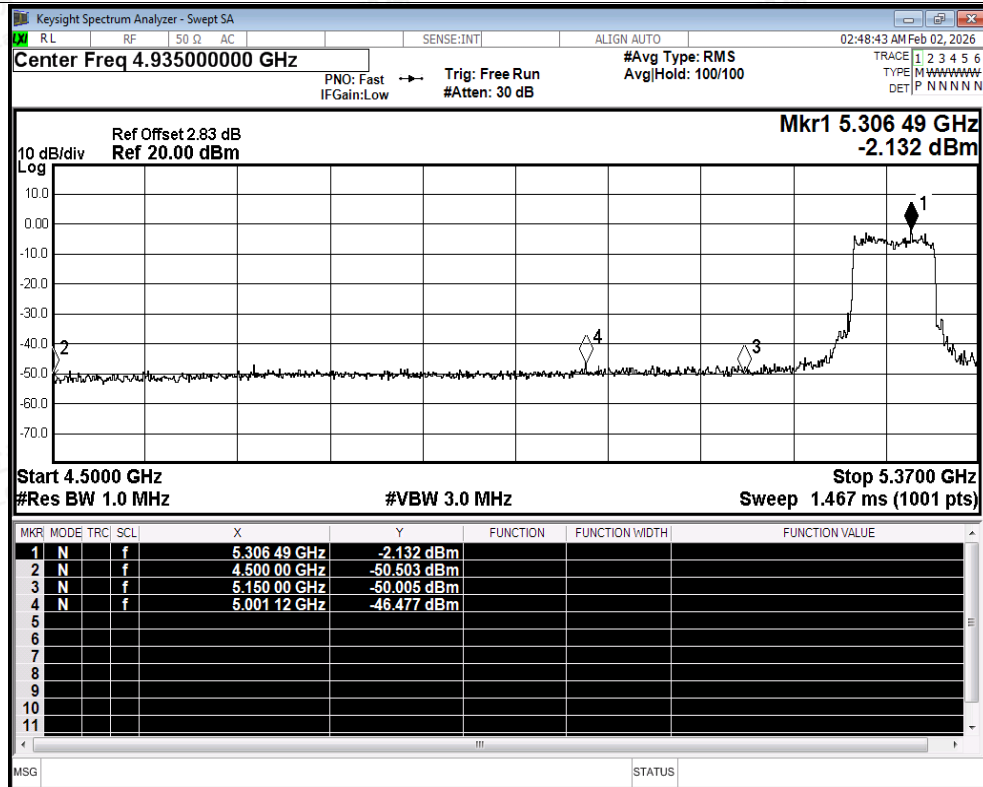

Restrict Band NVNT ac80 5290MHz Ant2 Peak

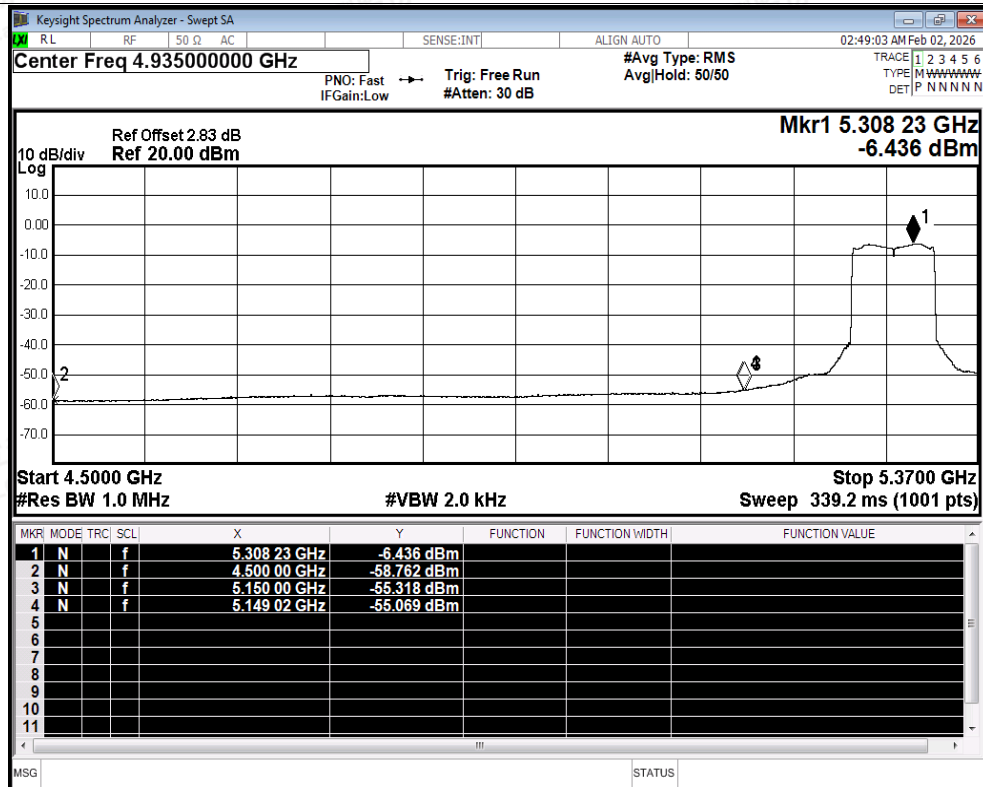

Restrict Band NVNT ac80 5290MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

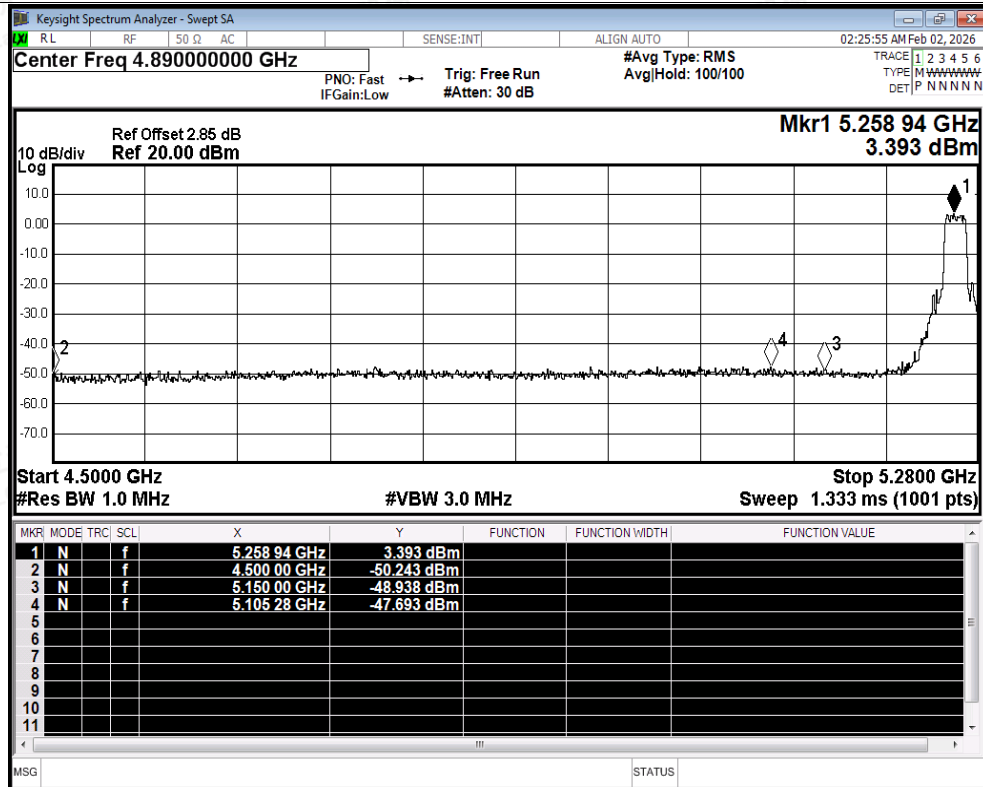

Restrict Band NVNT ax20 5260MHz Ant2 Peak

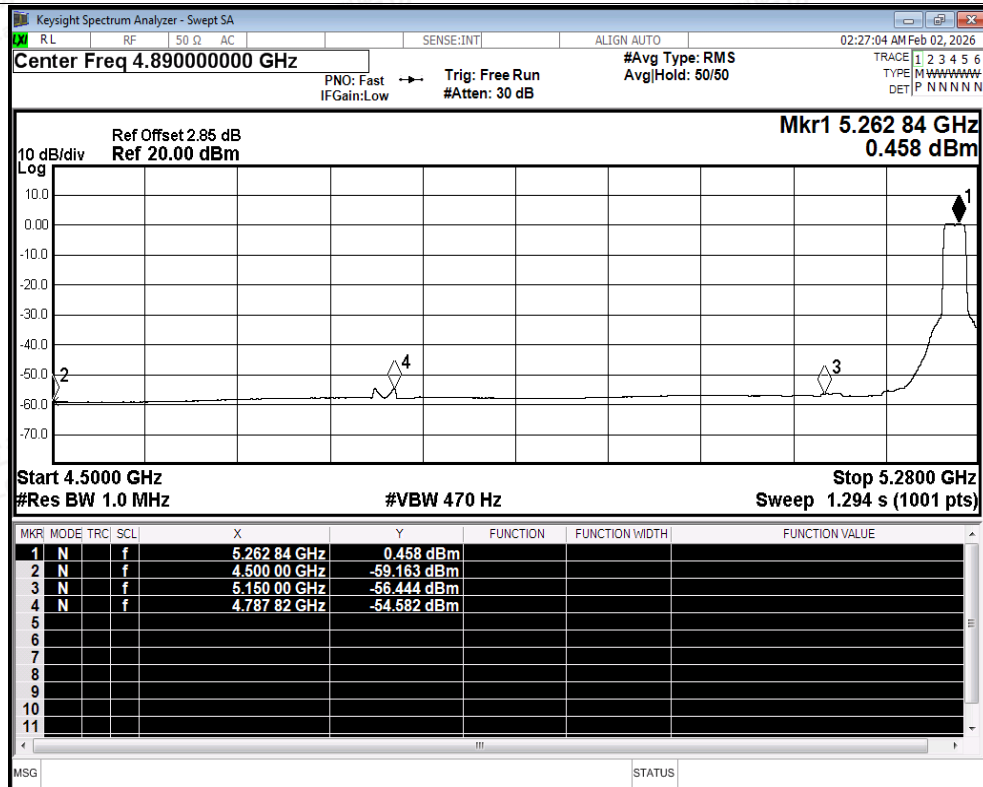

Restrict Band NVNT ax20 5260MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

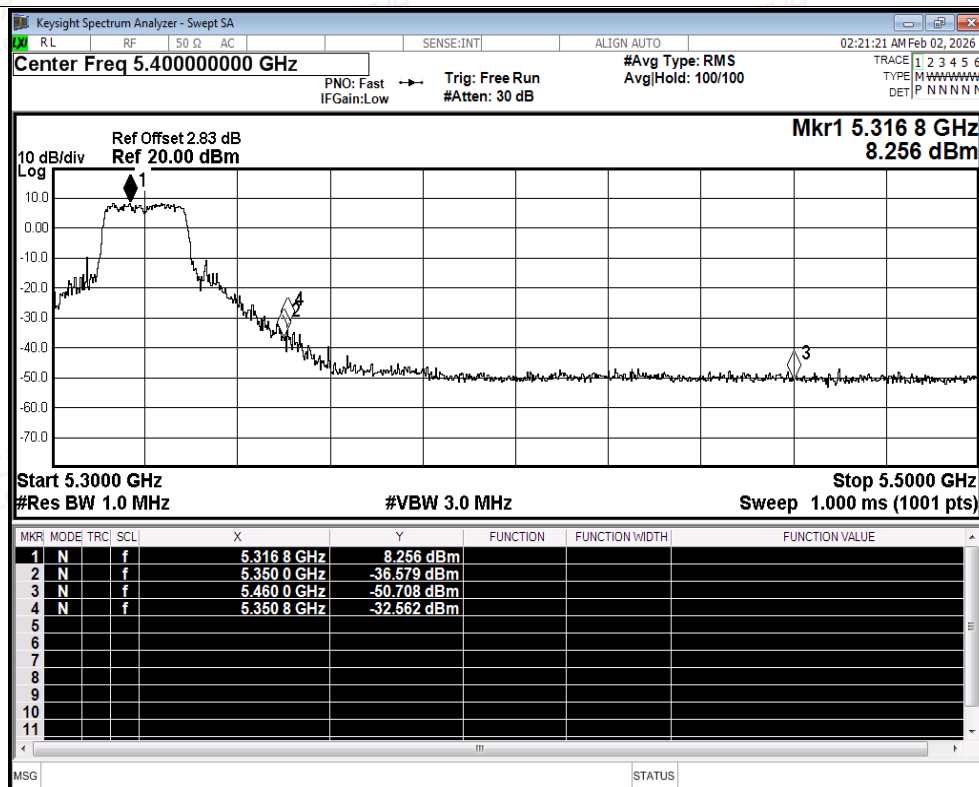

Restrict Band NVNT ax20 5320MHz Ant2 Peak

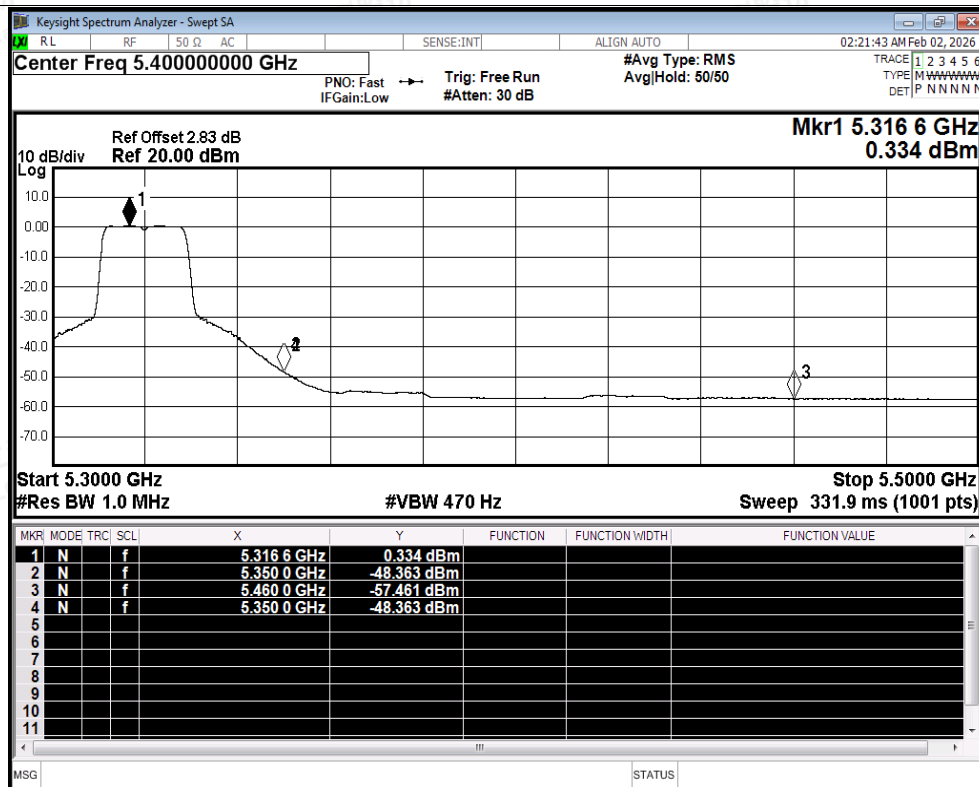

Restrict Band NVNT ax20 5320MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

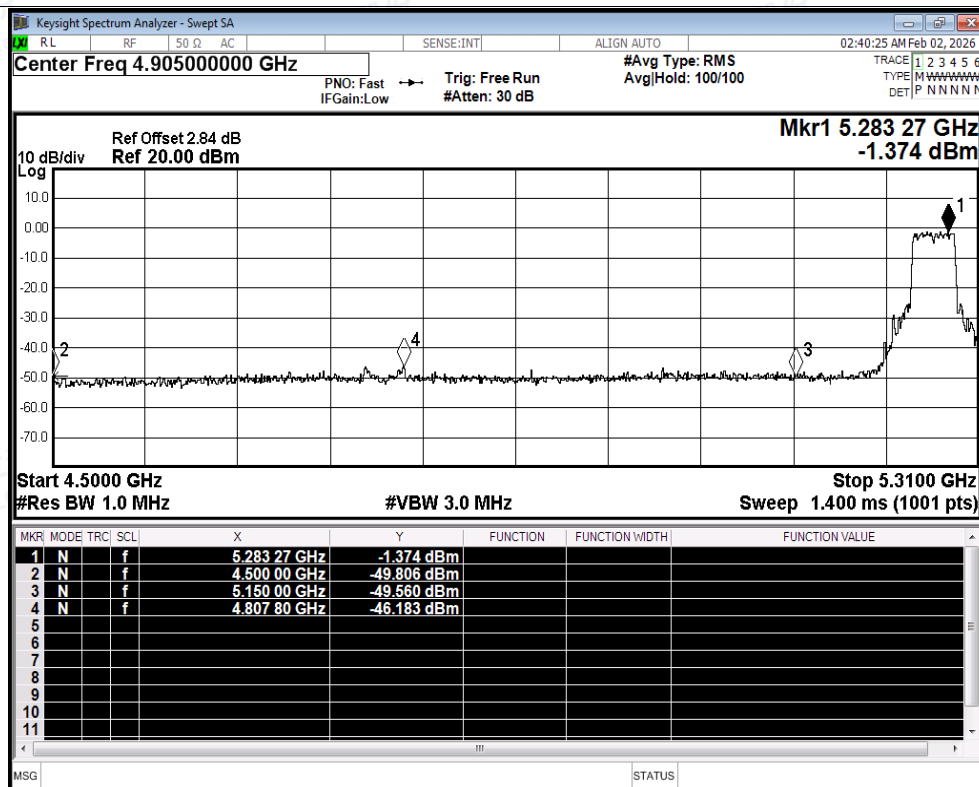

Restrict Band NVNT ax40 5270MHz Ant2 Peak

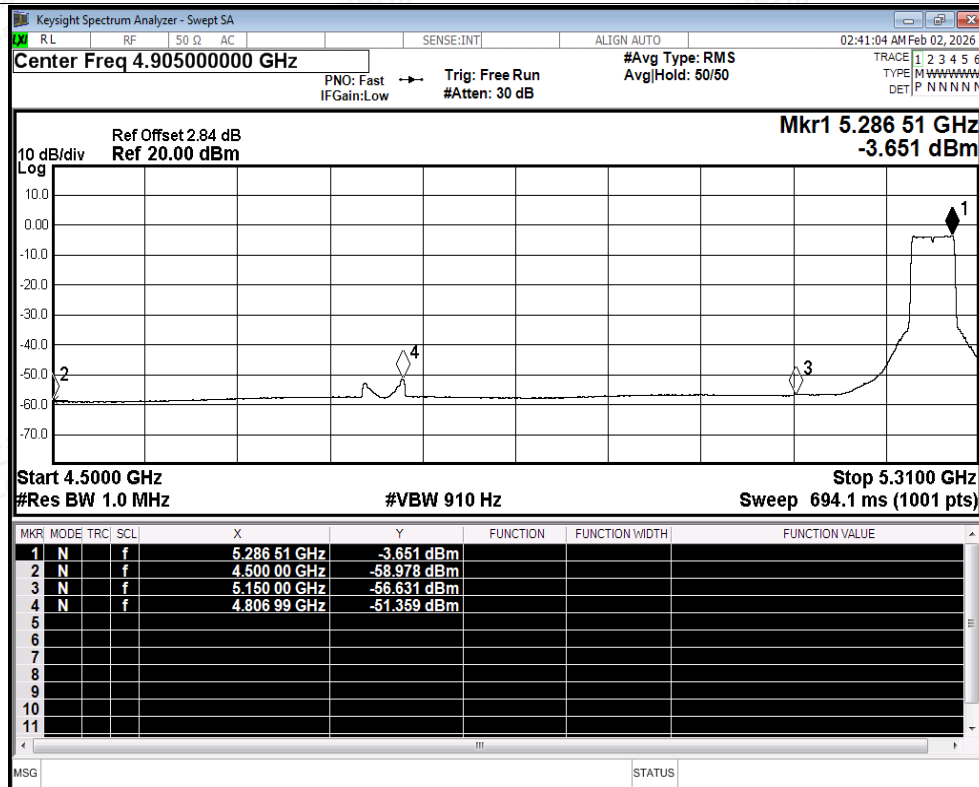

Restrict Band NVNT ax40 5270MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

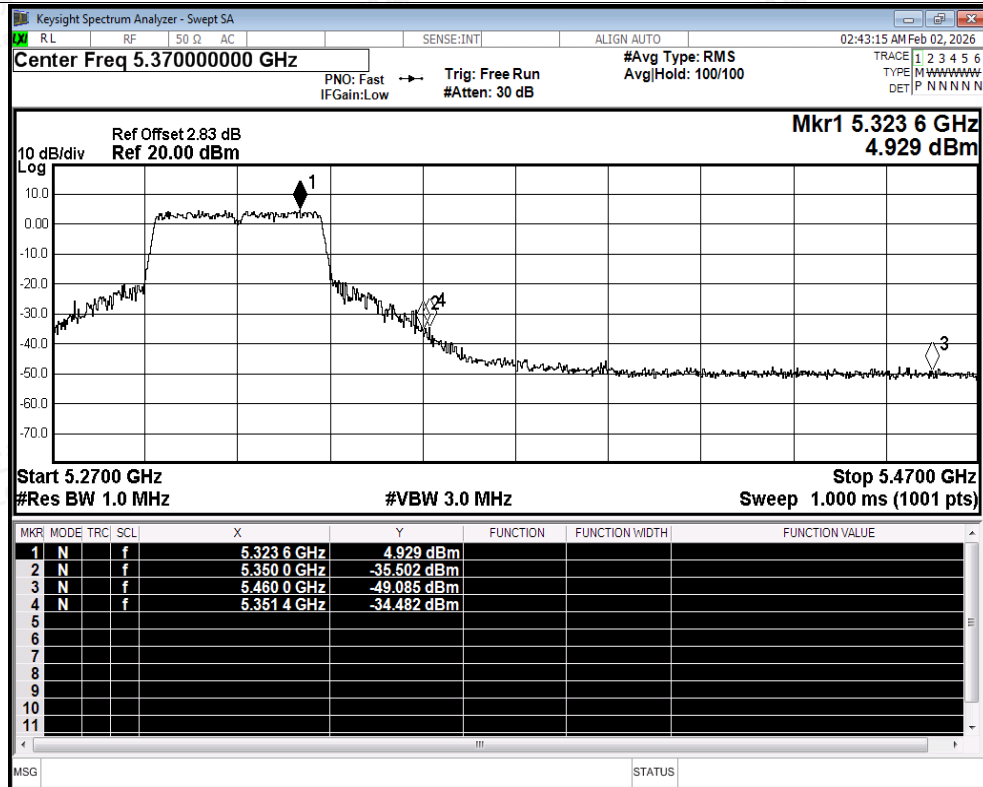

Restrict Band NVNT ax40 5310MHz Ant2 Peak

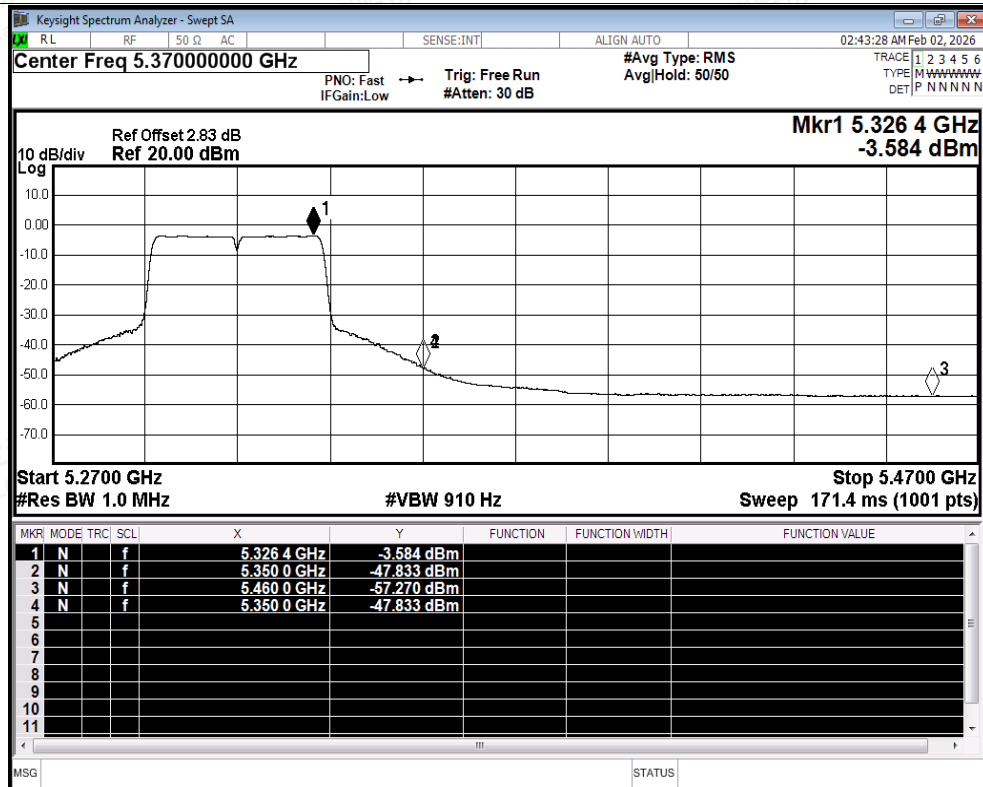

Restrict Band NVNT ax40 5310MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

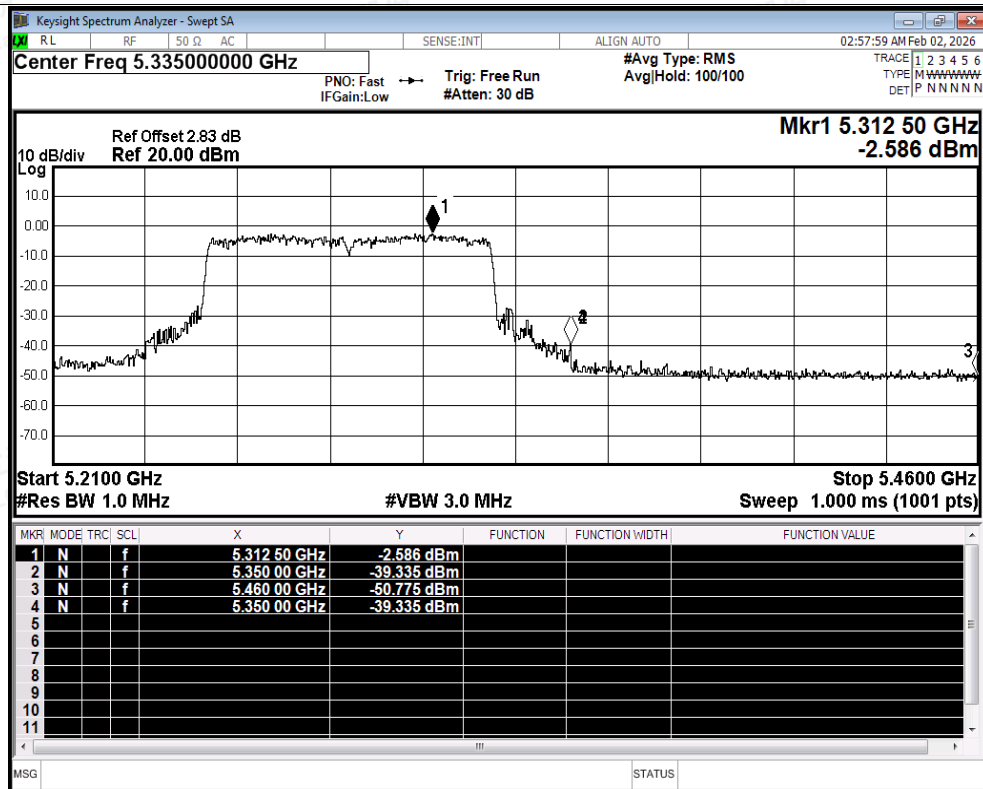

Restrict Band NVNT ax80 5290MHz Ant2 Peak

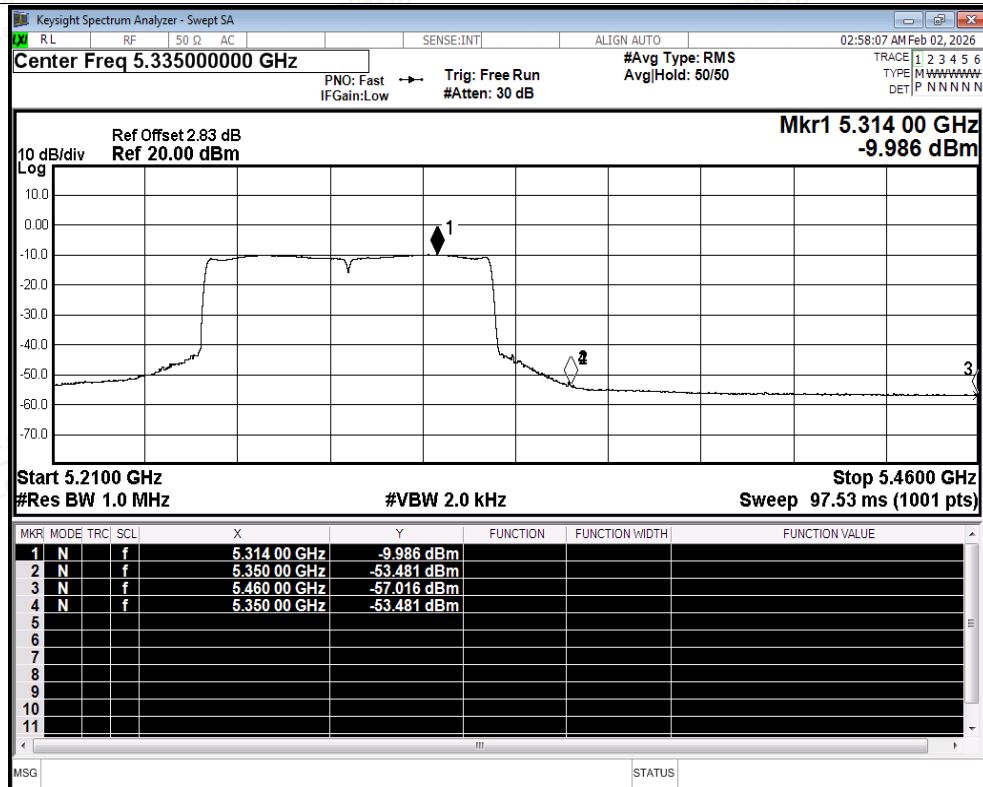

Restrict Band NVNT ax80 5290MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

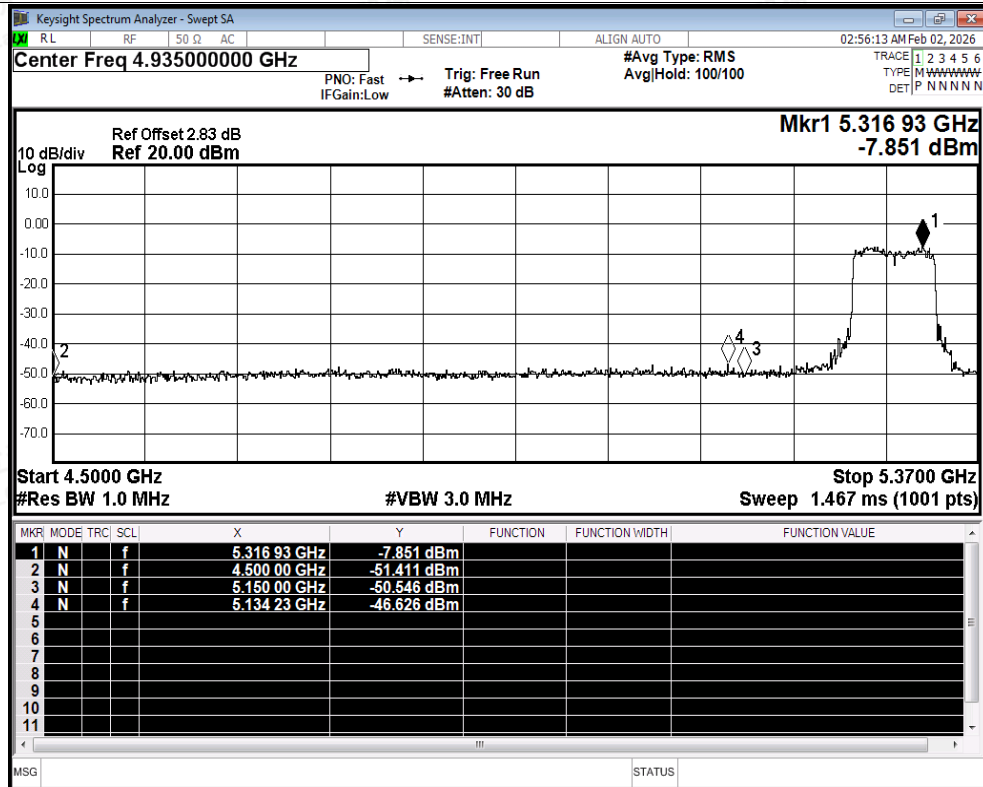

Restrict Band NVNT ax80 5290MHz Ant2 Peak

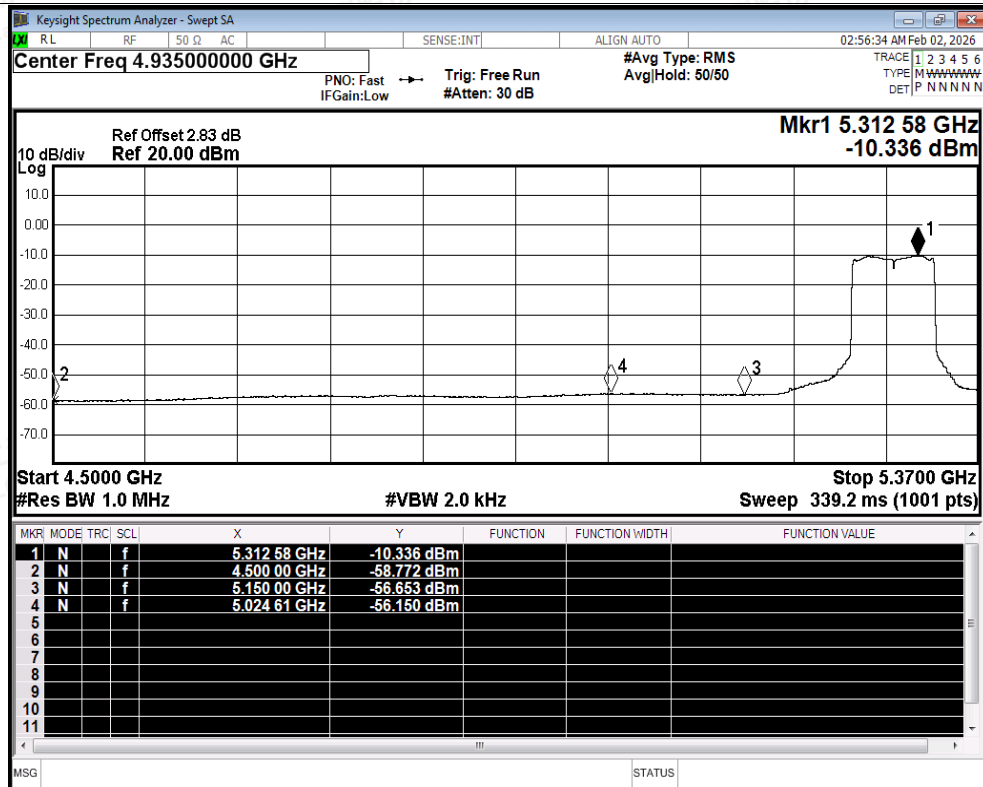

Restrict Band NVNT ax80 5290MHz Ant2 Average



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



MIMO

Condition	Mode	Frequency (MHz)	Ant1 Power (dBm)	Ant2 Power (dBm)	SUM	Gain (dBi)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	n20	5260	-51.42	-51.38	-48.39	8.59	55.43	Peak	68.2	Pass
NVNT	n20	5260	-58.70	-59.61	-56.12	8.59	47.70	Average	54	Pass
NVNT	n20	5260	-46.89	-46.54	-43.70	8.59	60.12	Peak	68.2	Pass
NVNT	n20	5260	-56.76	-56.48	-53.61	8.59	50.21	Average	54	Pass
NVNT	n20	5260	-49.07	-49.70	-46.36	8.59	57.45	Peak	68.2	Pass
NVNT	n20	5260	-57.16	-56.91	-54.02	8.59	49.79	Average	54	Pass
NVNT	n20	5320	-42.36	-42.19	-39.26	8.59	64.55	Peak	68.2	Pass
NVNT	n20	5320	-53.72	-53.64	-50.67	8.59	53.15	Average	54	Pass
NVNT	n20	5320	-39.52	-42.10	-37.61	8.59	66.21	Peak	68.2	Pass
NVNT	n20	5320	-53.86	-53.22	-50.52	8.59	53.30	Average	54	Pass
NVNT	n20	5320	-48.74	-49.45	-46.07	8.59	57.75	Peak	68.2	Pass
NVNT	n20	5320	-58.08	-57.66	-54.85	8.59	48.96	Average	54	Pass
NVNT	n40	5270	-50.97	-49.84	-47.36	8.59	56.46	Peak	68.2	Pass
NVNT	n40	5270	-59.00	-59.16	-56.07	8.59	47.75	Average	54	Pass
NVNT	n40	5270	-46.16	-46.41	-43.27	8.59	60.54	Peak	68.2	Pass
NVNT	n40	5270	-54.55	-54.57	-51.55	8.59	52.27	Average	54	Pass
NVNT	n40	5270	-48.83	-49.83	-46.29	8.59	57.53	Peak	68.2	Pass
NVNT	n40	5270	-57.51	-57.81	-54.65	8.59	49.17	Average	54	Pass
NVNT	n40	5310	-39.65	-42.77	-37.93	8.59	65.89	Peak	68.2	Pass
NVNT	n40	5310	-53.99	-54.22	-51.09	8.59	52.72	Average	54	Pass
NVNT	n40	5310	-39.85	-40.29	-37.05	8.59	66.76	Peak	68.2	Pass
NVNT	n40	5310	-53.64	-53.95	-50.78	8.59	53.04	Average	54	Pass
NVNT	n40	5310	-50.46	-48.72	-46.49	8.59	57.32	Peak	68.2	Pass
NVNT	n40	5310	-58.05	-57.95	-54.99	8.59	48.83	Average	54	Pass
NVNT	ac20	5260	-51.96	-50.07	-47.90	8.59	55.91	Peak	68.2	Pass
NVNT	ac20	5260	-59.59	-58.61	-56.06	8.59	47.76	Average	54	Pass
NVNT	ac20	5260	-45.86	-46.23	-43.03	8.59	60.79	Peak	68.2	Pass
NVNT	ac20	5260	-56.72	-56.55	-53.62	8.59	50.19	Average	54	Pass
NVNT	ac20	5260	-48.71	-49.24	-45.96	8.59	57.86	Peak	68.2	Pass
NVNT	ac20	5260	-57.07	-57.52	-54.28	8.59	49.54	Average	54	Pass
NVNT	ac20	5320	-43.96	-47.70	-42.43	8.59	61.39	Peak	68.2	Pass
NVNT	ac20	5320	-54.09	-54.94	-51.48	8.59	52.33	Average	54	Pass
NVNT	ac20	5320	-47.94	-47.85	-44.88	8.59	58.93	Peak	68.2	Pass
NVNT	ac20	5320	-56.49	-57.71	-54.05	8.59	49.77	Average	54	Pass
NVNT	ac20	5320	-49.16	-50.80	-46.89	8.59	56.92	Peak	68.2	Pass
NVNT	ac20	5320	-57.68	-58.03	-54.84	8.59	48.98	Average	54	Pass
NVNT	ac40	5270	-50.77	-51.27	-48.00	8.59	55.82	Peak	68.2	Pass
NVNT	ac40	5270	-58.83	-58.86	-55.83	8.59	47.98	Average	54	Pass
NVNT	ac40	5270	-45.53	-45.90	-42.70	8.59	61.12	Peak	68.2	Pass
NVNT	ac40	5270	-54.82	-54.06	-51.41	8.59	52.40	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac40	5270	-48.75	-49.05	-45.89	8.59	57.93	Peak	68.2	Pass
NVNT	ac40	5270	-57.72	-57.18	-54.43	8.59	49.39	Average	54	Pass
NVNT	ac40	5310	-41.32	-37.78	-36.19	8.59	67.63	Peak	68.2	Pass
NVNT	ac40	5310	-53.64	-53.49	-50.55	8.59	53.26	Average	54	Pass
NVNT	ac40	5310	-49.80	-47.52	-45.50	8.59	58.32	Peak	68.2	Pass
NVNT	ac40	5310	-53.57	-53.58	-50.56	8.59	53.25	Average	54	Pass
NVNT	ac40	5310	-49.64	-50.02	-46.82	8.59	57.00	Peak	68.2	Pass
NVNT	ac40	5310	-58.24	-58.24	-55.23	8.59	48.59	Average	54	Pass
NVNT	ac80	5290	-50.38	-50.58	-47.47	8.59	56.35	Peak	68.2	Pass
NVNT	ac80	5290	-59.04	-58.98	-56.00	8.59	47.82	Average	54	Pass
NVNT	ac80	5290	-46.75	-46.92	-43.82	8.59	59.99	Peak	68.2	Pass
NVNT	ac80	5290	-56.59	-56.71	-53.64	8.59	50.18	Average	54	Pass
NVNT	ac80	5290	-48.84	-47.08	-44.86	8.59	58.96	Peak	68.2	Pass
NVNT	ac80	5290	-56.79	-57.31	-54.03	8.59	49.79	Average	54	Pass
NVNT	ac80	5290	-45.84	-45.18	-42.49	8.59	61.33	Peak	68.2	Pass
NVNT	ac80	5290	-54.17	-54.15	-51.15	8.59	52.67	Average	54	Pass
NVNT	ac80	5290	-43.07	-41.41	-39.15	8.59	64.67	Peak	68.2	Pass
NVNT	ac80	5290	-54.07	-54.05	-51.05	8.59	52.77	Average	54	Pass
NVNT	ac80	5290	-49.57	-50.13	-46.83	8.59	56.99	Peak	68.2	Pass
NVNT	ac80	5290	-57.65	-58.11	-54.86	8.59	48.95	Average	54	Pass
NVNT	ax20	5260	-50.06	-51.36	-47.65	8.59	56.17	Peak	68.2	Pass
NVNT	ax20	5260	-59.28	-59.44	-56.35	8.59	47.47	Average	54	Pass
NVNT	ax20	5260	-46.55	-46.22	-43.37	8.59	60.45	Peak	68.2	Pass
NVNT	ax20	5260	-56.06	-56.34	-53.19	8.59	50.63	Average	54	Pass
NVNT	ax20	5260	-46.81	-49.64	-44.99	8.59	58.83	Peak	68.2	Pass
NVNT	ax20	5260	-56.82	-57.19	-53.99	8.59	49.83	Average	54	Pass
NVNT	ax20	5320	-38.83	-43.42	-37.53	8.59	66.28	Peak	68.2	Pass
NVNT	ax20	5320	-54.52	-55.13	-51.80	8.59	52.01	Average	54	Pass
NVNT	ax20	5320	-38.88	-40.88	-36.76	8.59	67.06	Peak	68.2	Pass
NVNT	ax20	5320	-53.95	-53.34	-50.62	8.59	53.19	Average	54	Pass
NVNT	ax20	5320	-48.40	-50.25	-46.22	8.59	57.60	Peak	68.2	Pass
NVNT	ax20	5320	-57.89	-58.11	-54.99	8.59	48.83	Average	54	Pass
NVNT	ax40	5270	-49.26	-50.69	-46.91	8.59	56.91	Peak	68.2	Pass
NVNT	ax40	5270	-58.81	-59.39	-56.08	8.59	47.74	Average	54	Pass
NVNT	ax40	5270	-45.35	-45.89	-42.60	8.59	61.22	Peak	68.2	Pass
NVNT	ax40	5270	-54.37	-54.69	-51.52	8.59	52.30	Average	54	Pass
NVNT	ax40	5270	-47.53	-50.37	-45.71	8.59	58.11	Peak	68.2	Pass
NVNT	ax40	5270	-57.52	-57.12	-54.31	8.59	49.51	Average	54	Pass
NVNT	ax40	5310	-44.59	-42.64	-40.50	8.59	63.32	Peak	68.2	Pass
NVNT	ax40	5310	-54.00	-53.95	-50.96	8.59	52.85	Average	54	Pass
NVNT	ax40	5310	-41.28	-40.44	-37.83	8.59	65.99	Peak	68.2	Pass
NVNT	ax40	5310	-53.07	-53.94	-50.47	8.59	53.34	Average	54	Pass
NVNT	ax40	5310	-50.25	-49.45	-46.82	8.59	57.00	Peak	68.2	Pass
NVNT	ax40	5310	-57.98	-57.80	-54.88	8.59	48.94	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax80	5290	-42.84	-43.02	-39.92	8.59	63.90	Peak	68.2	Pass
NVNT	ax80	5290	-54.33	-54.49	-51.40	8.59	52.42	Average	54	Pass
NVNT	ax80	5290	-39.82	-42.43	-37.92	8.59	65.90	Peak	68.2	Pass
NVNT	ax80	5290	-54.16	-54.09	-51.11	8.59	52.70	Average	54	Pass
NVNT	ax80	5290	-49.85	-49.57	-46.70	8.59	57.12	Peak	68.2	Pass
NVNT	ax80	5290	-57.82	-57.65	-54.72	8.59	49.09	Average	54	Pass
NVNT	ax80	5290	-50.76	-48.98	-46.77	8.59	57.05	Peak	68.2	Pass
NVNT	ax80	5290	-58.79	-58.38	-55.57	8.59	48.25	Average	54	Pass
NVNT	ax80	5290	-46.41	-45.73	-43.05	8.59	60.77	Peak	68.2	Pass
NVNT	ax80	5290	-56.78	-56.59	-53.67	8.59	50.14	Average	54	Pass
NVNT	ax80	5290	-48.89	-49.26	-46.06	8.59	57.76	Peak	68.2	Pass
NVNT	ax80	5290	-56.87	-56.88	-53.86	8.59	49.95	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



E.5 Frequency Stability

Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5260	Ant1	5260	0	0	25	Pass
NVNT	a	5280	Ant1	5279.98	-20000	-3.79	25	Pass
NVNT	a	5320	Ant1	5319.98	-20000	-3.76	25	Pass
NVNT	n20	5260	Ant1	5259.96	-40000	-7.6	25	Pass
NVNT	n20	5280	Ant1	5279.98	-20000	-3.79	25	Pass
NVNT	n20	5320	Ant1	5320	0	0	25	Pass
NVNT	n40	5270	Ant1	5269.96	-40000	-7.59	25	Pass
NVNT	n40	5310	Ant1	5309.96	-40000	-7.53	25	Pass
NVNT	ac20	5260	Ant1	5259.98	-20000	-3.8	25	Pass
NVNT	ac20	5280	Ant1	5279.98	-20000	-3.79	25	Pass
NVNT	ac20	5320	Ant1	5319.98	-20000	-3.76	25	Pass
NVNT	ac40	5270	Ant1	5269.96	-40000	-7.59	25	Pass
NVNT	ac40	5310	Ant1	5310	0	0	25	Pass
NVNT	ac80	5290	Ant1	5290	0	0	25	Pass
NVNT	ax20	5260	Ant1	5259.98	-20000	-3.8	25	Pass
NVNT	ax20	5280	Ant1	5280	0	0	25	Pass
NVNT	ax20	5320	Ant1	5319.98	-20000	-3.76	25	Pass
NVNT	ax40	5270	Ant1	5270	0	0	25	Pass
NVNT	ax40	5310	Ant1	5310	0	0	25	Pass
NVNT	ax80	5290	Ant1	5290	0	0	25	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

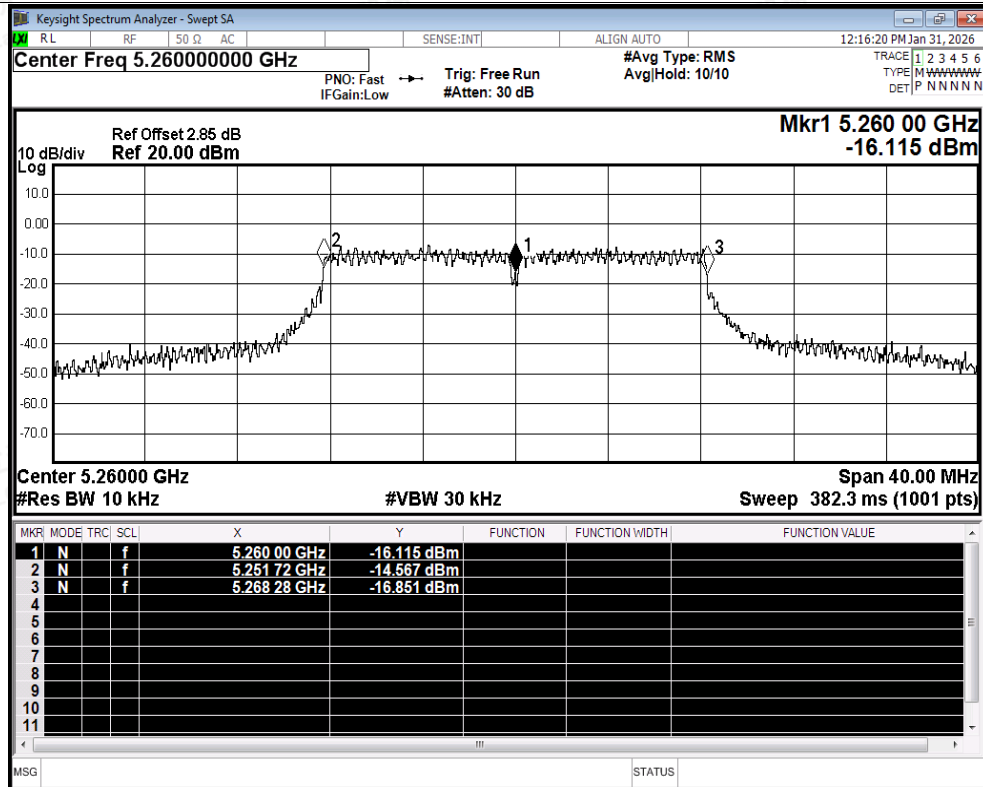

Freq. Stability NVNT a 5260MHz Ant1

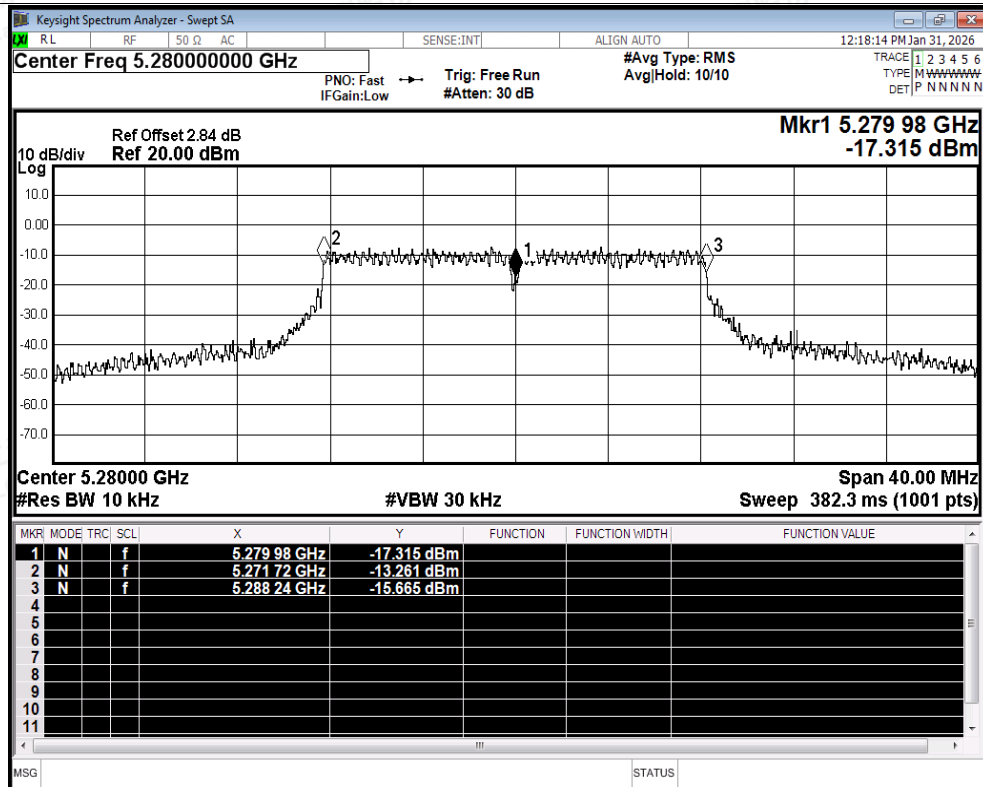

Freq. Stability NVNT a 5280MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

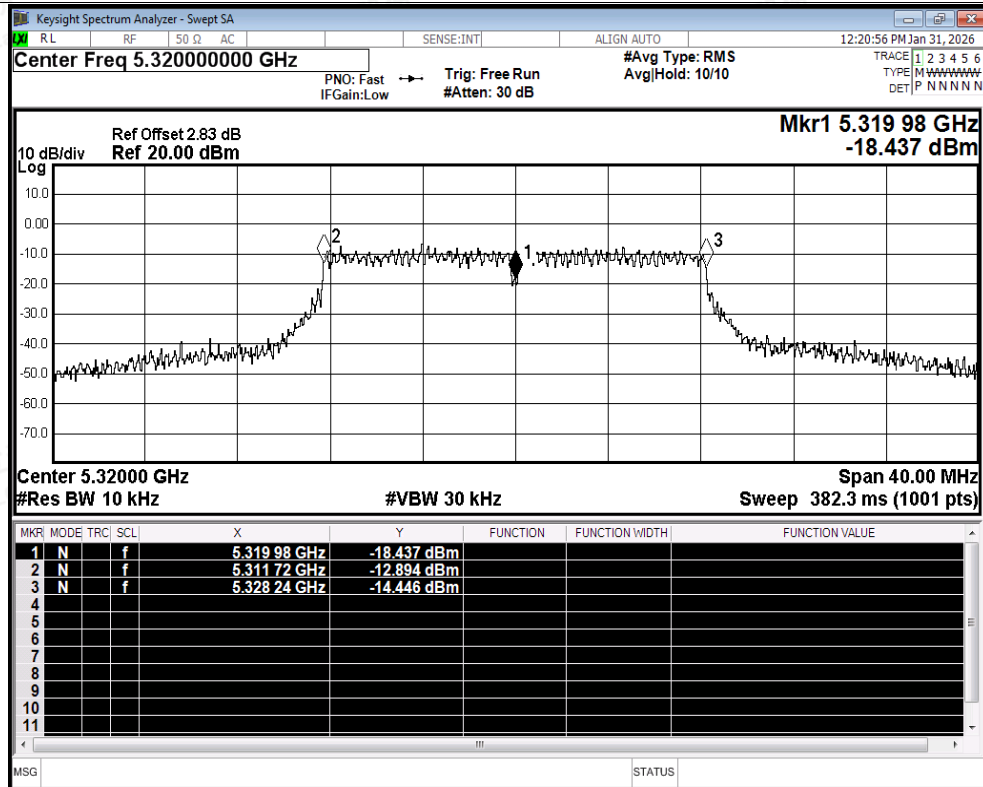

Freq. Stability NVNT a 5320MHz Ant1

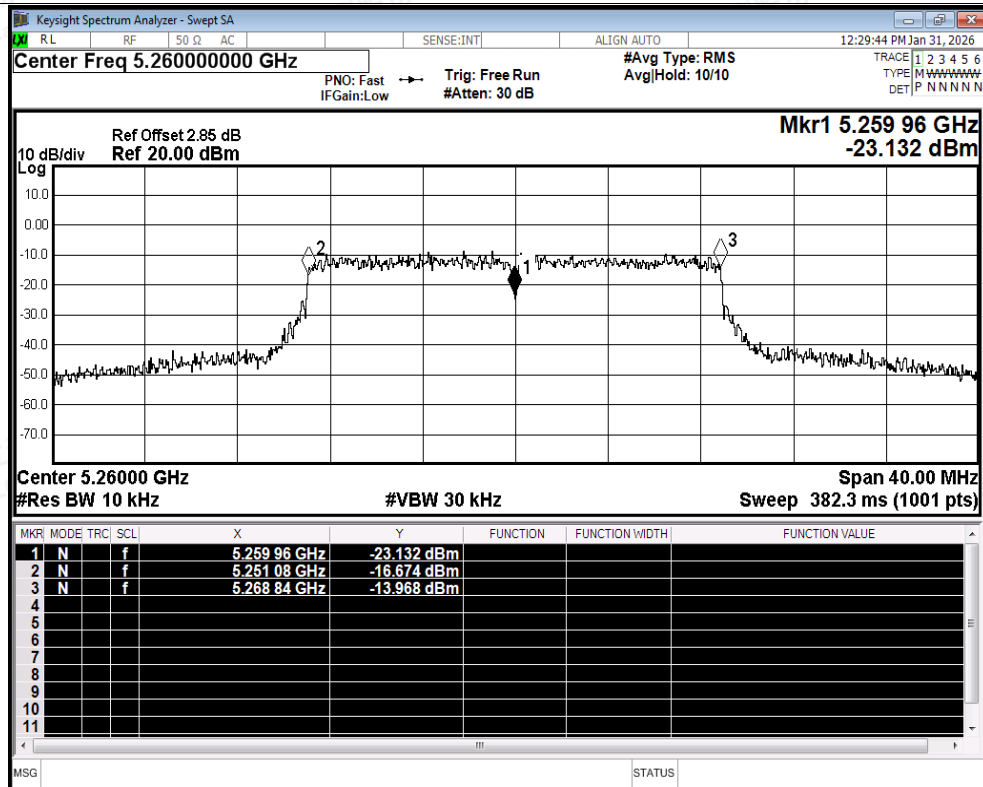

Freq. Stability NVNT n20 5260MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

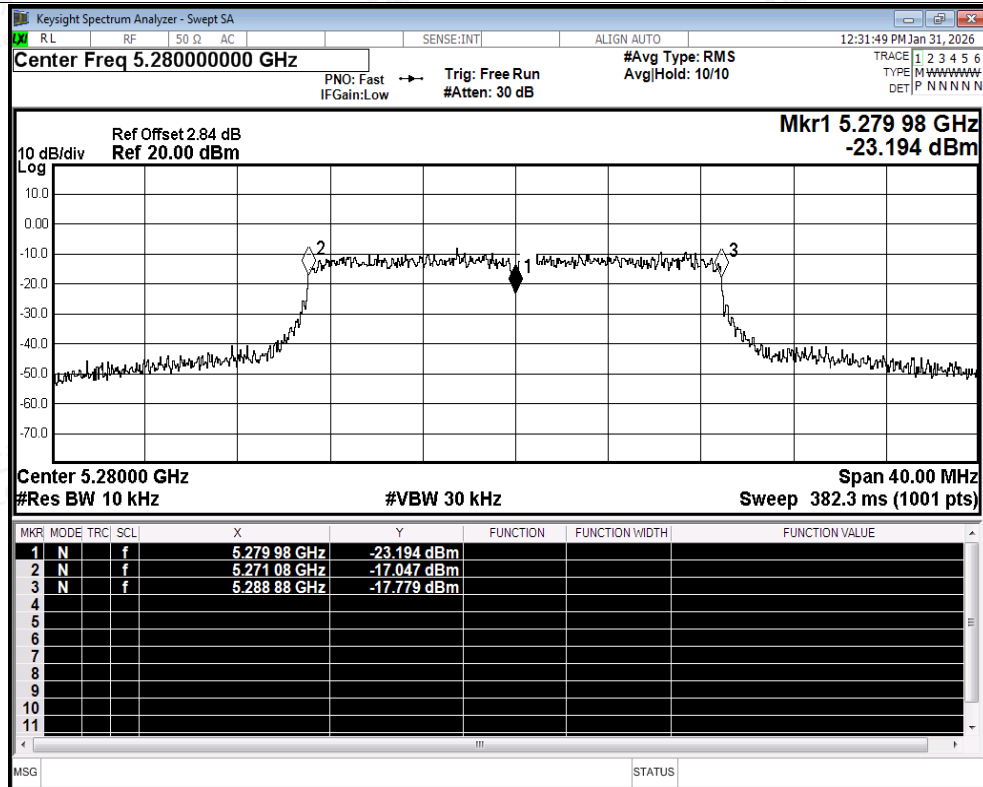

Freq. Stability NVNT n20 5280MHz Ant1

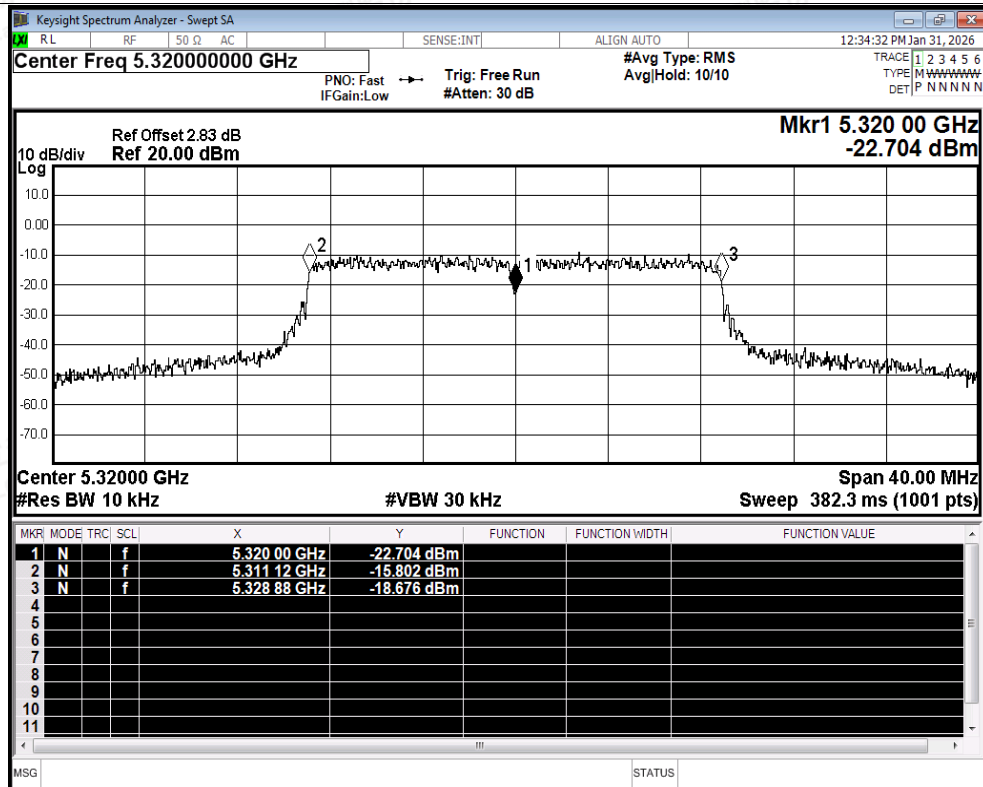

Freq. Stability NVNT n20 5320MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

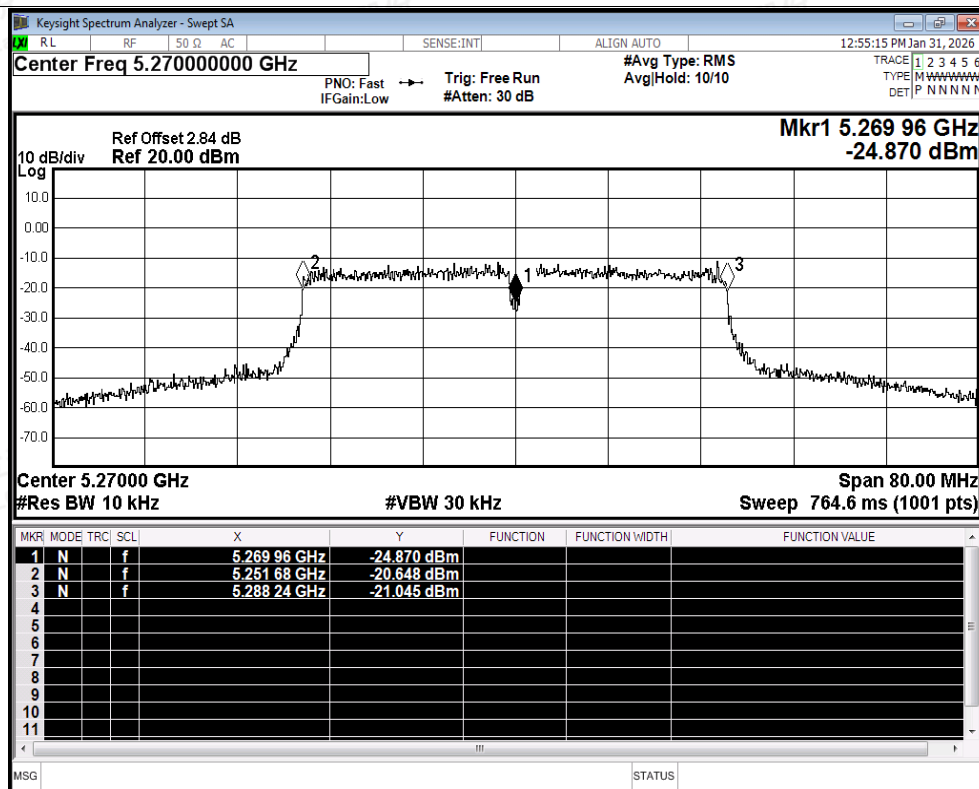

Freq. Stability NVNT n40 5270MHz Ant1

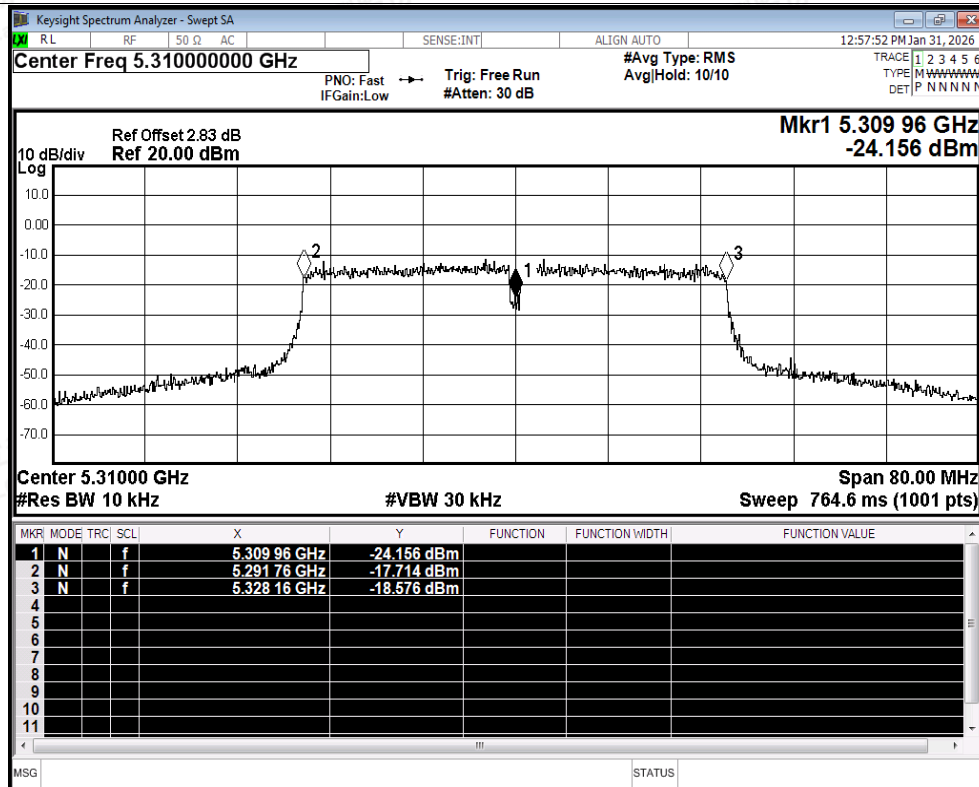

Freq. Stability NVNT n40 5310MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

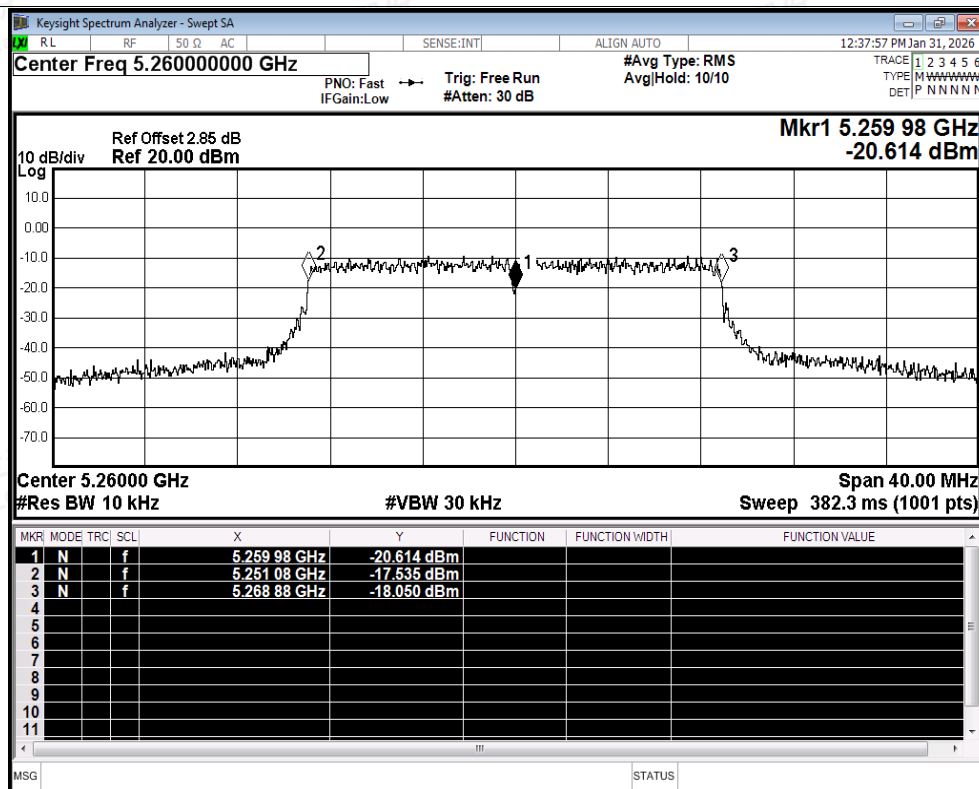

Freq. Stability NVNT ac20 5260MHz Ant1

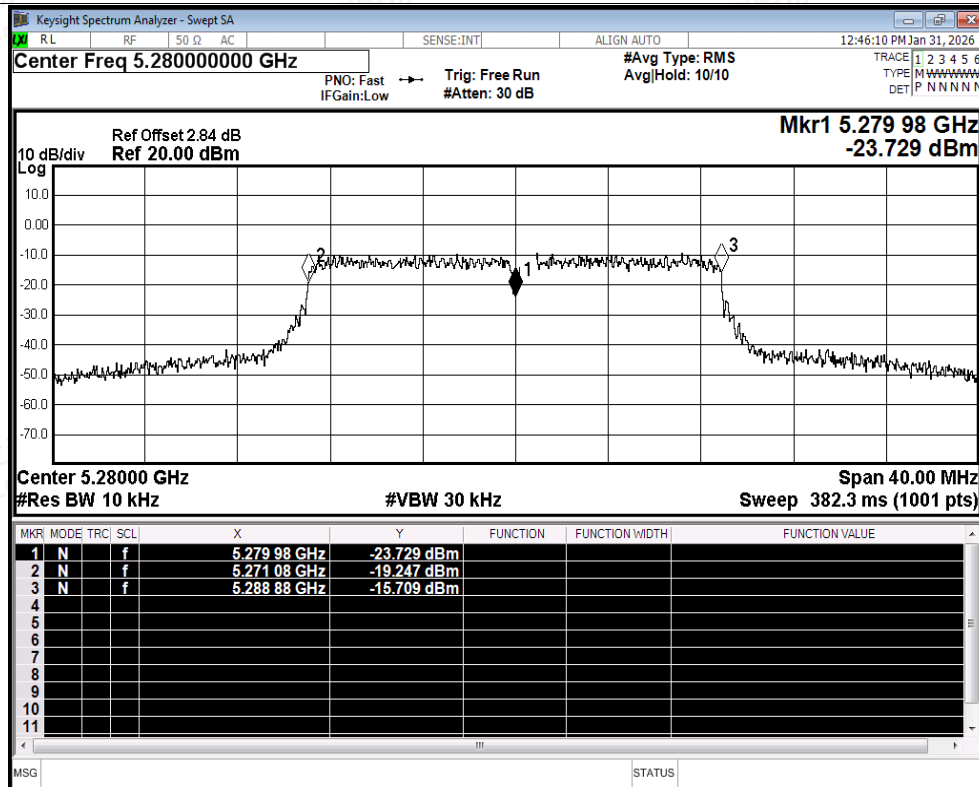

Freq. Stability NVNT ac20 5280MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

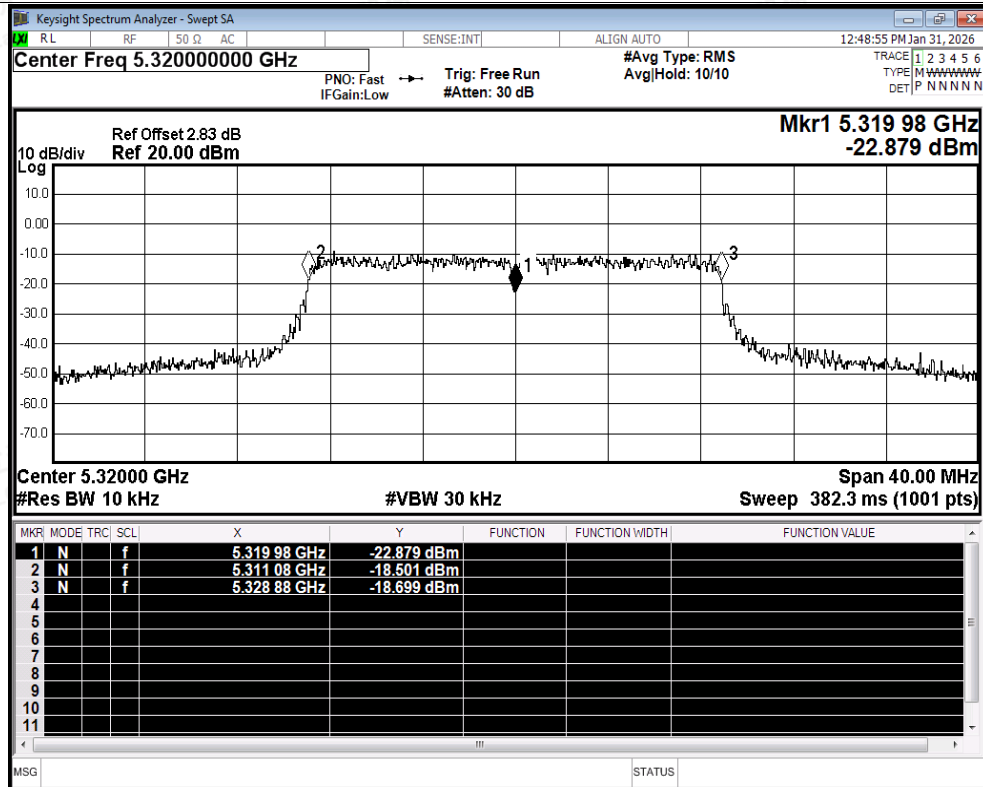

Freq. Stability NVNT ac20 5320MHz Ant1

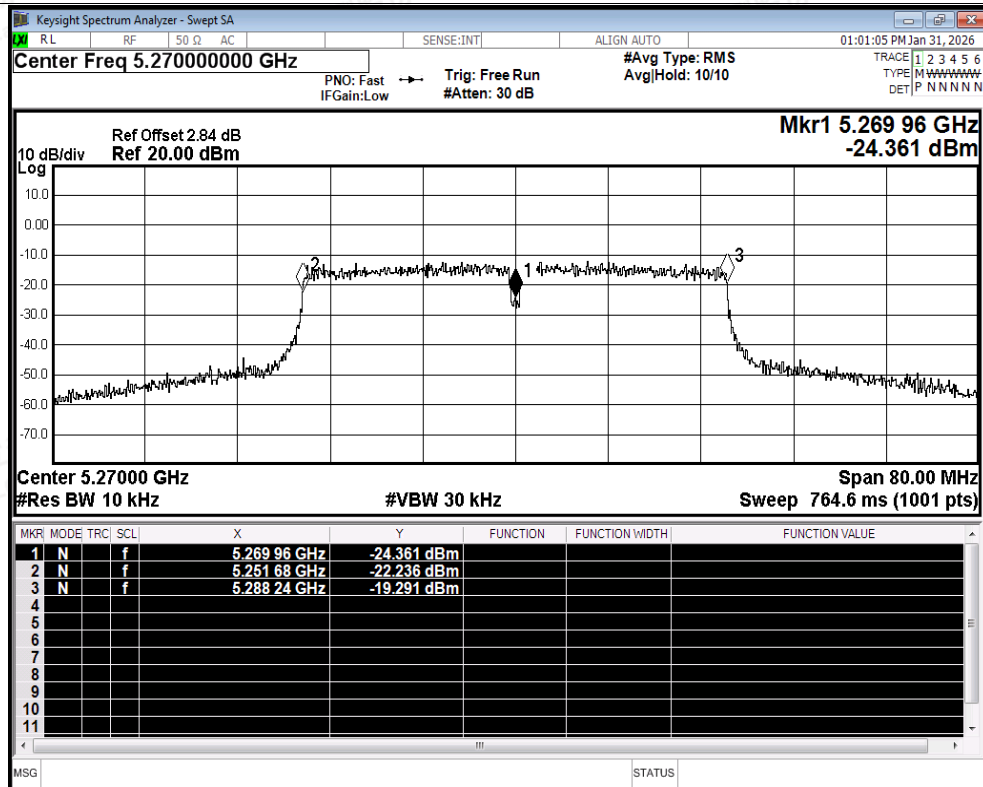

Freq. Stability NVNT ac40 5270MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

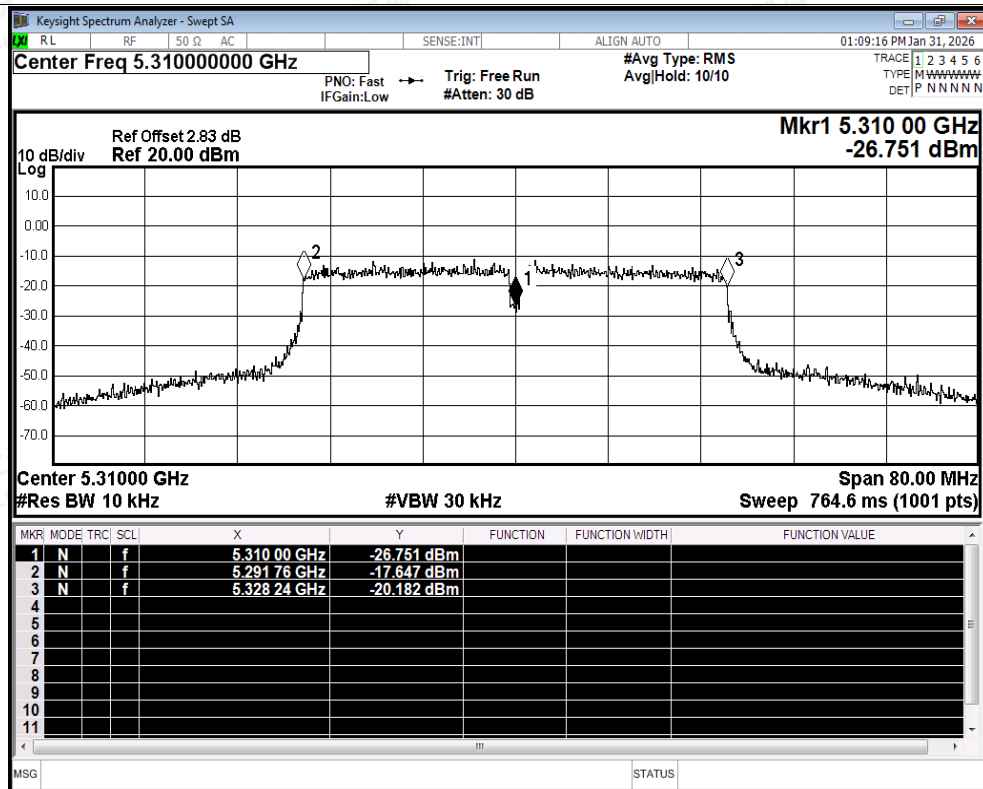

Freq. Stability NVNT ac40 5310MHz Ant1

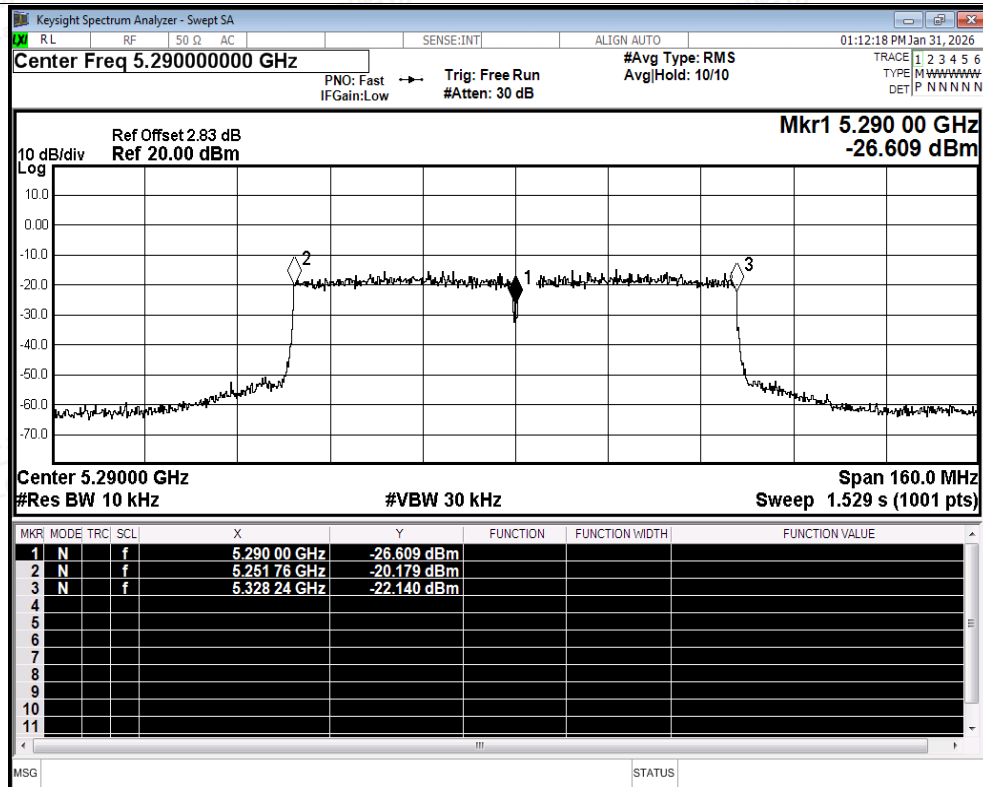

Freq. Stability NVNT ac80 5290MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

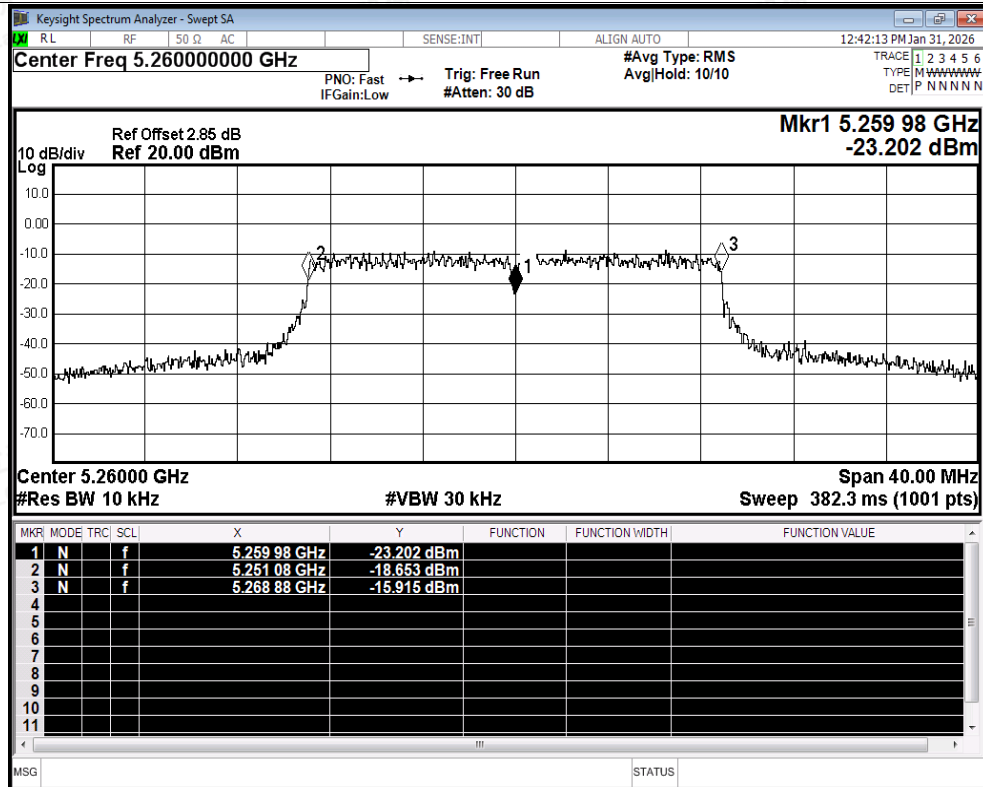

Freq. Stability NVNT ax20 5260MHz Ant1

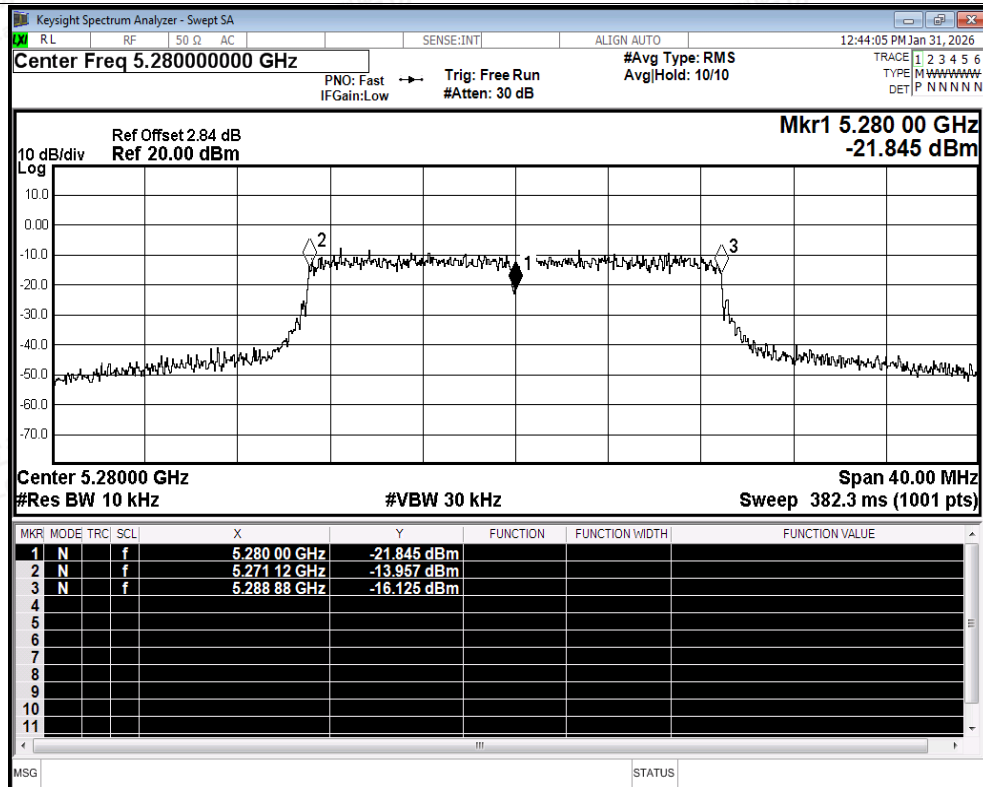

Freq. Stability NVNT ax20 5280MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

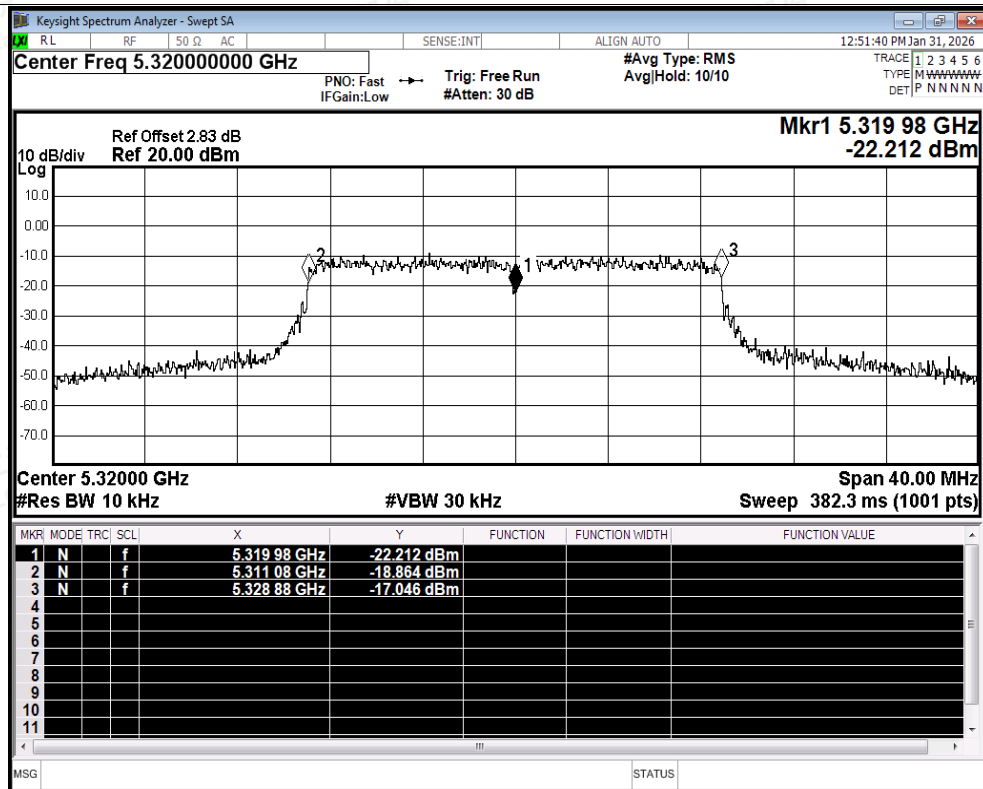

Freq. Stability NVNT ax20 5320MHz Ant1

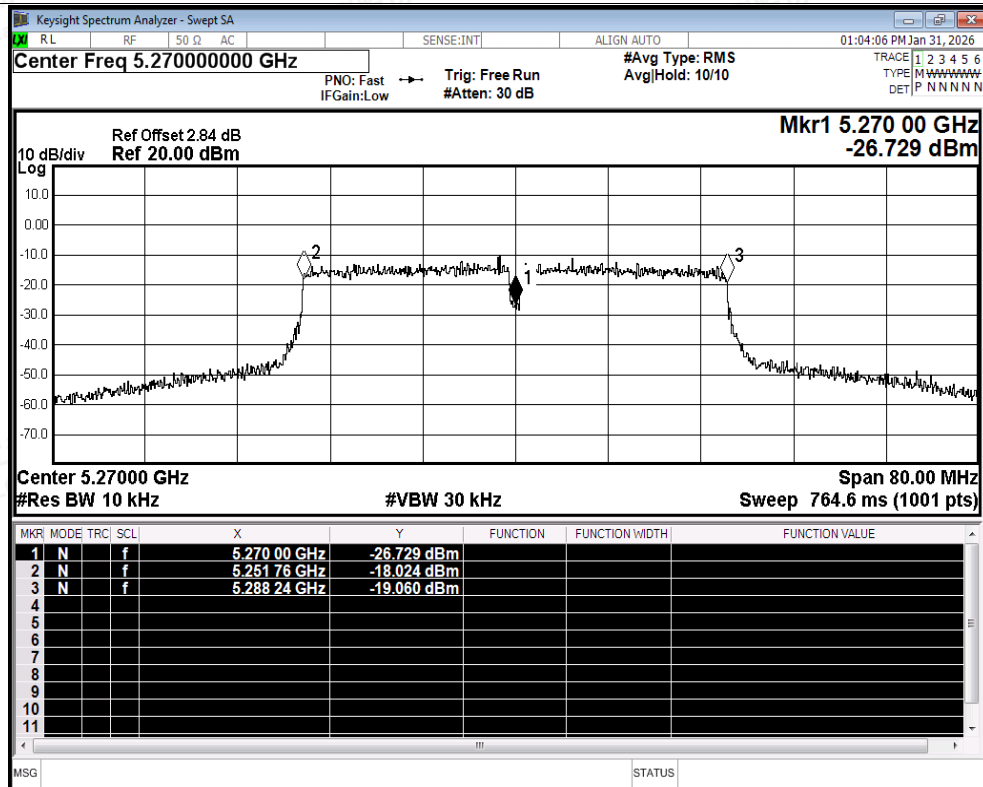

Freq. Stability NVNT ax40 5270MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

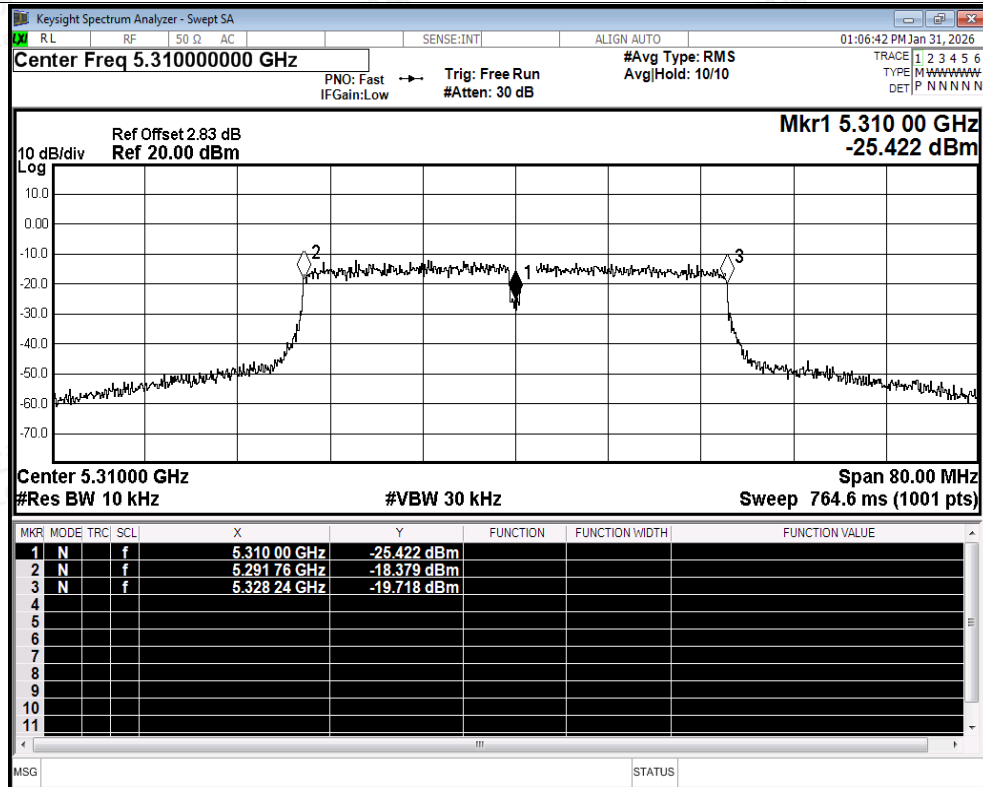

Freq. Stability NVNT ax40 5310MHz Ant1

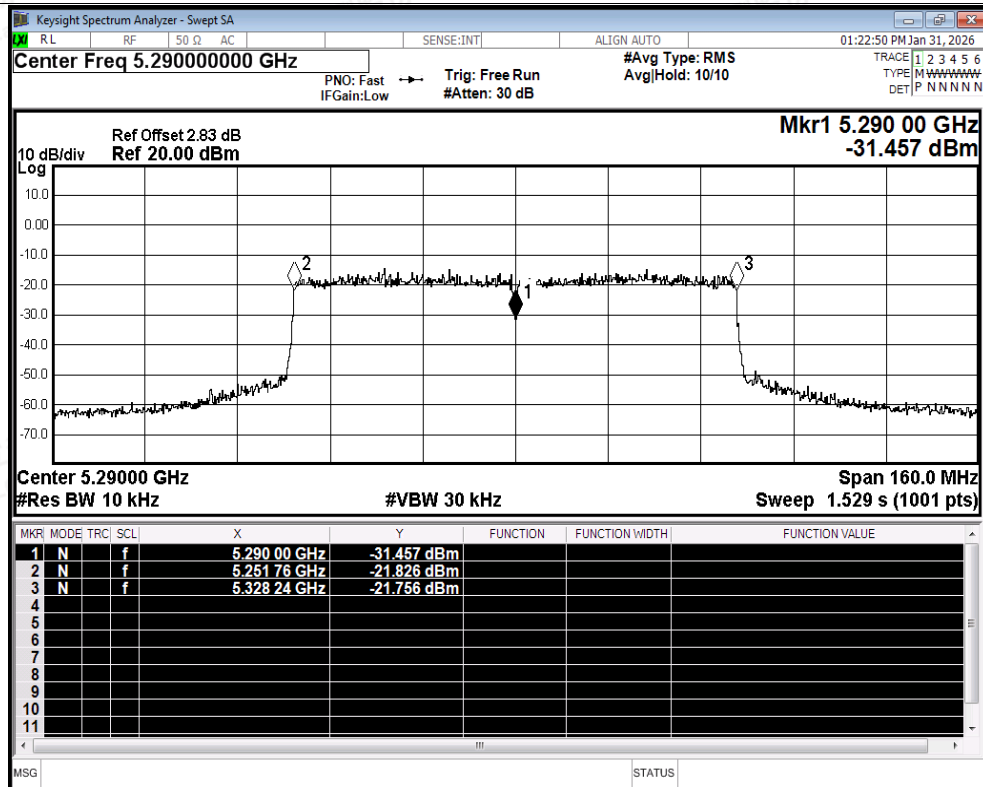

Freq. Stability NVNT ax80 5290MHz Ant1



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5260	Ant2	5260	0	0	25	Pass
NVNT	a	5280	Ant2	5280	0	0	25	Pass
NVNT	a	5320	Ant2	5320	0	0	25	Pass
NVNT	n20	5260	Ant2	5259.98	-20000	-3.8	25	Pass
NVNT	n20	5280	Ant2	5279.98	-20000	-3.79	25	Pass
NVNT	n20	5320	Ant2	5319.98	-20000	-3.76	25	Pass
NVNT	n40	5270	Ant2	5270	0	0	25	Pass
NVNT	n40	5310	Ant2	5310	0	0	25	Pass
NVNT	ac20	5260	Ant2	5259.98	-20000	-3.8	25	Pass
NVNT	ac20	5280	Ant2	5279.98	-20000	-3.79	25	Pass
NVNT	ac20	5320	Ant2	5319.98	-20000	-3.76	25	Pass
NVNT	ac40	5270	Ant2	5270	0	0	25	Pass
NVNT	ac40	5310	Ant2	5310	0	0	25	Pass
NVNT	ac80	5290	Ant2	5290	0	0	25	Pass
NVNT	ax20	5260	Ant2	5259.98	-20000	-3.8	25	Pass
NVNT	ax20	5280	Ant2	5279.96	-40000	-7.58	25	Pass
NVNT	ax20	5320	Ant2	5319.98	-20000	-3.76	25	Pass
NVNT	ax40	5270	Ant2	5269.96	-40000	-7.59	25	Pass
NVNT	ax40	5310	Ant2	5309.96	-40000	-7.53	25	Pass
NVNT	ax80	5290	Ant2	5290	0	0	25	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

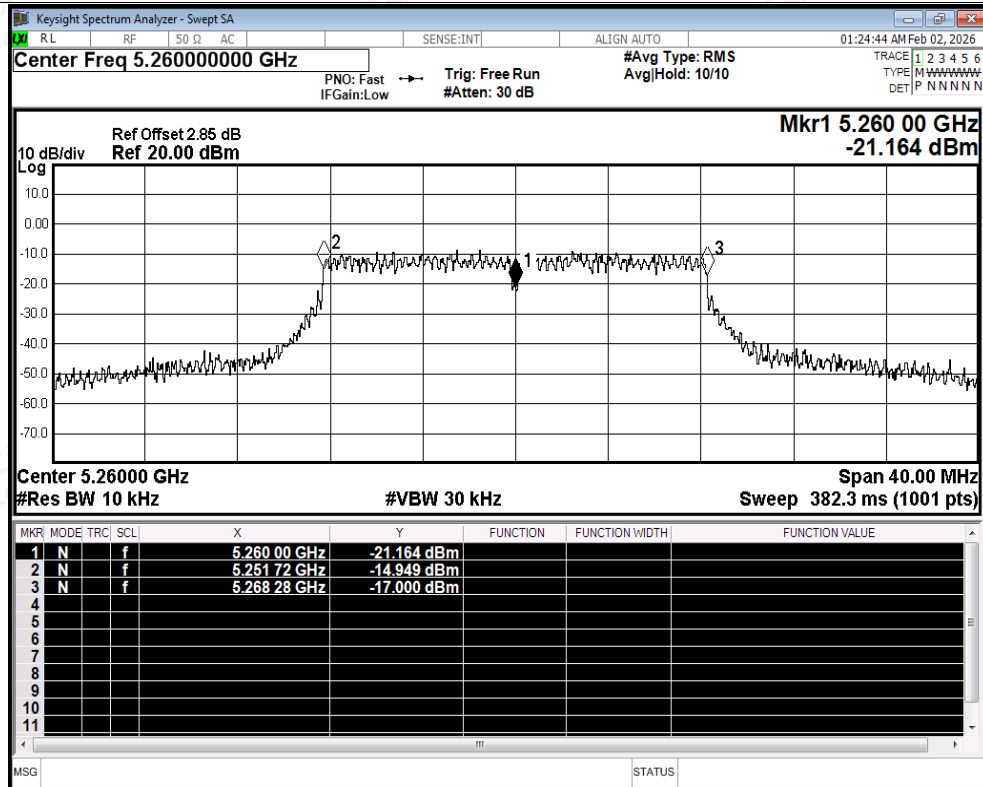

Freq. Stability NVNT a 5260MHz Ant2

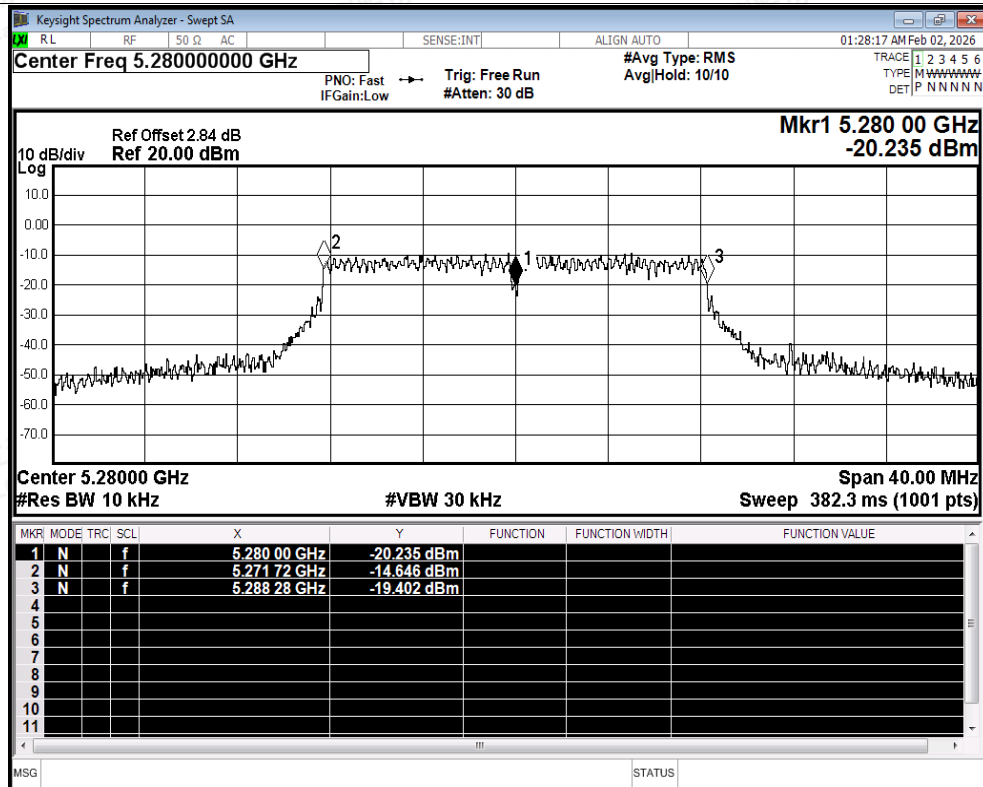

Freq. Stability NVNT a 5280MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

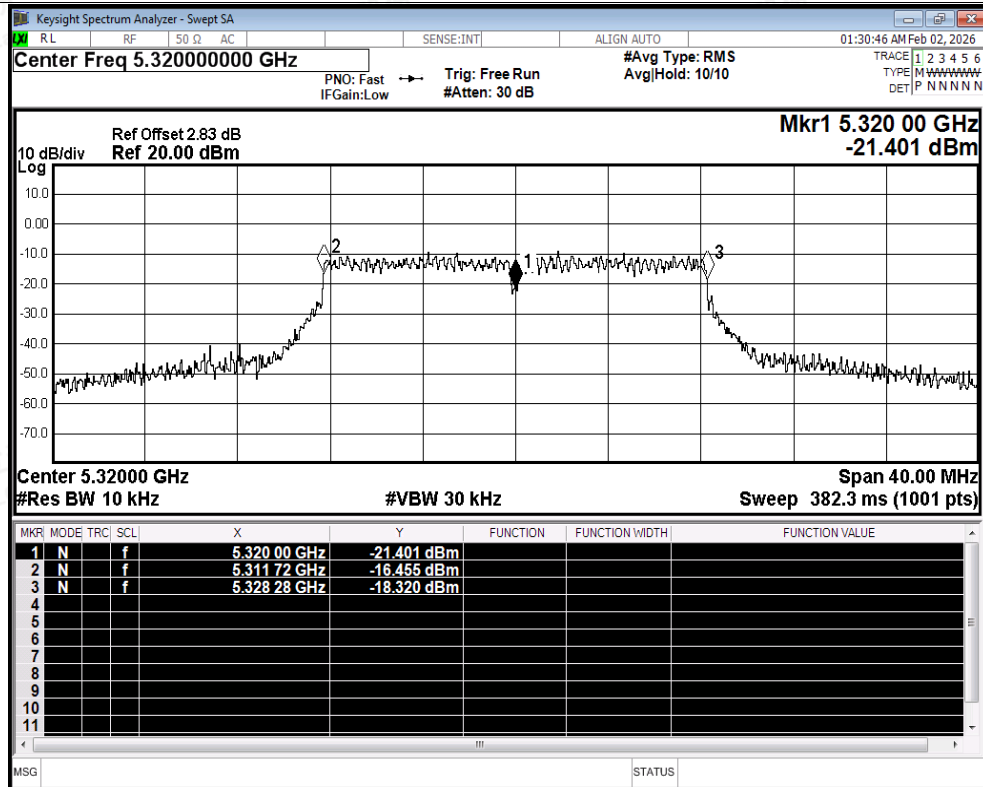

Freq. Stability NVNT a 5320MHz Ant2

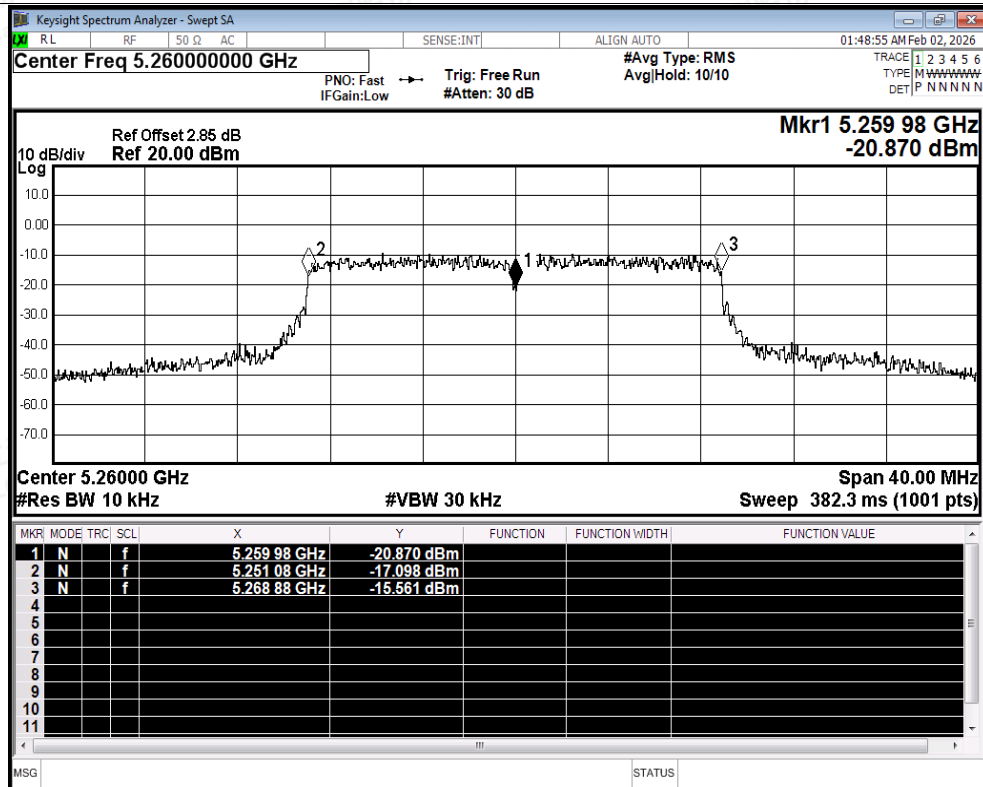

Freq. Stability NVNT n20 5260MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

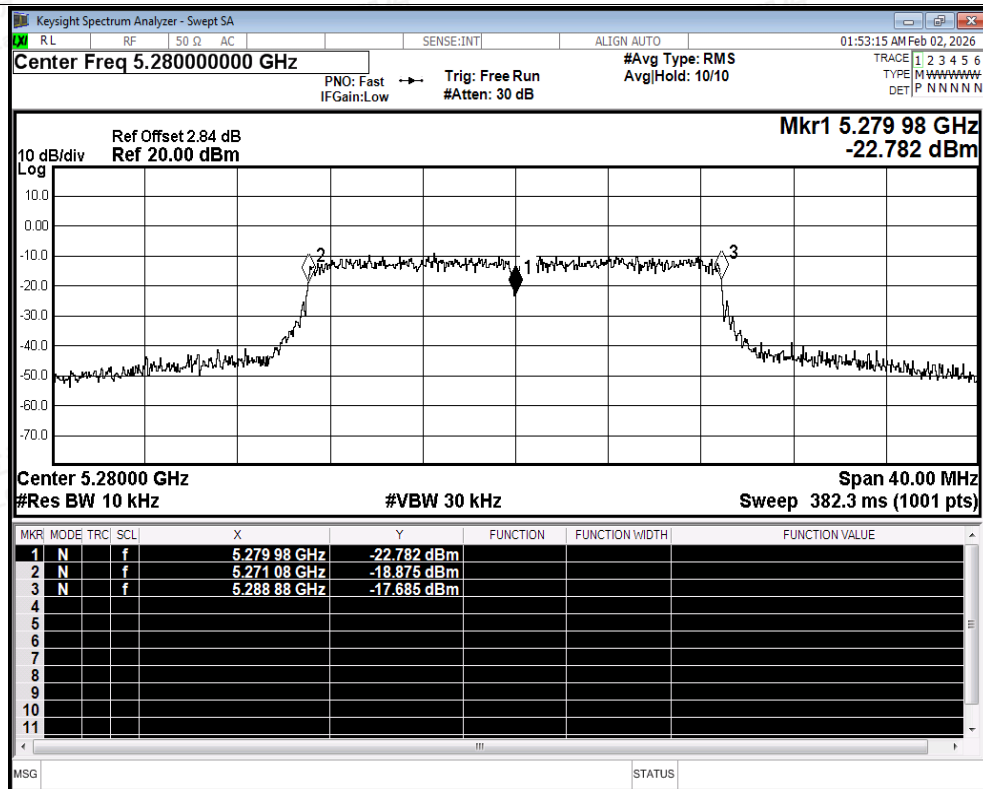

Freq. Stability NVNT n20 5280MHz Ant2

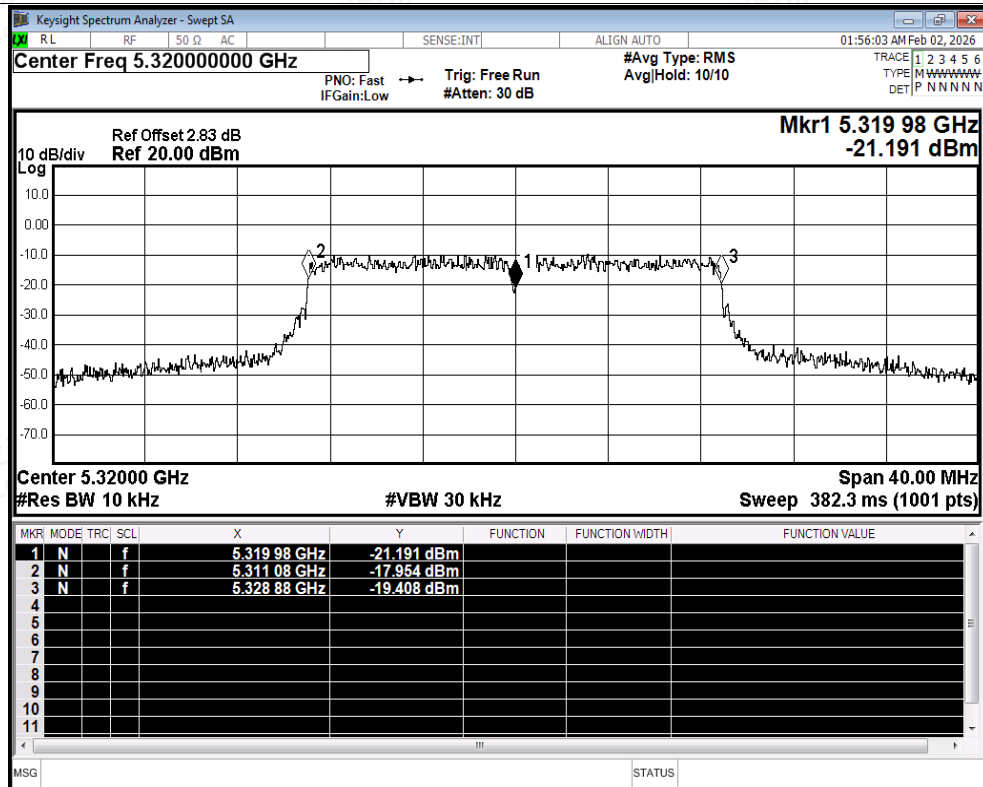

Freq. Stability NVNT n20 5320MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

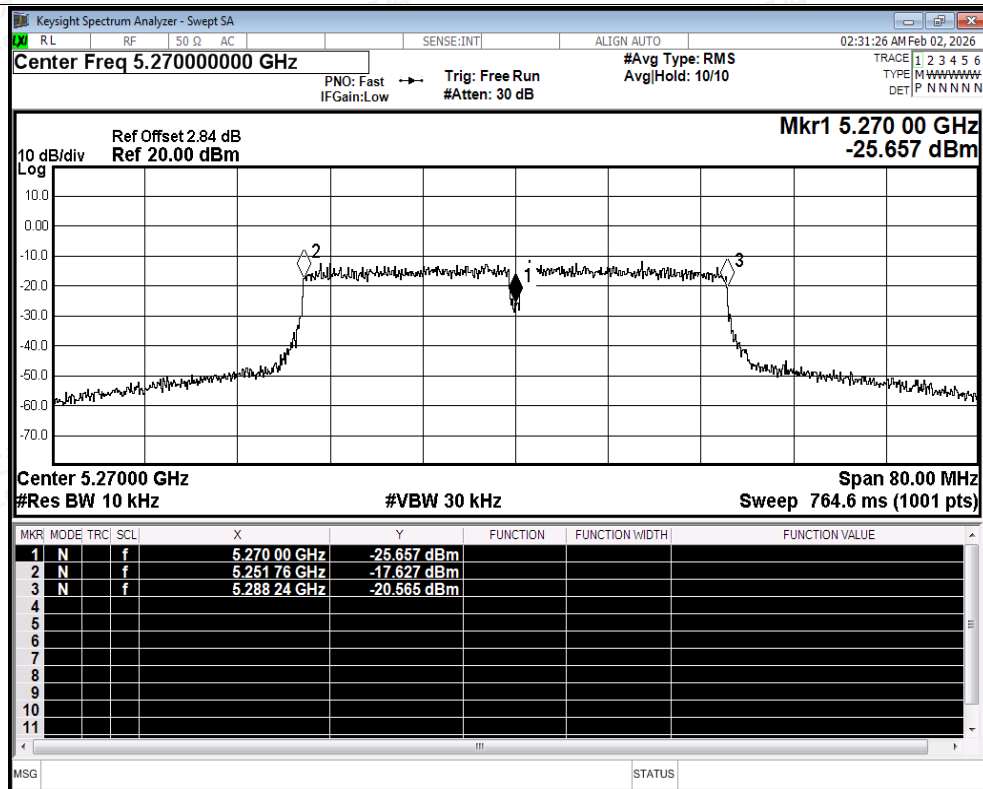

Freq. Stability NVNT n40 5270MHz Ant2

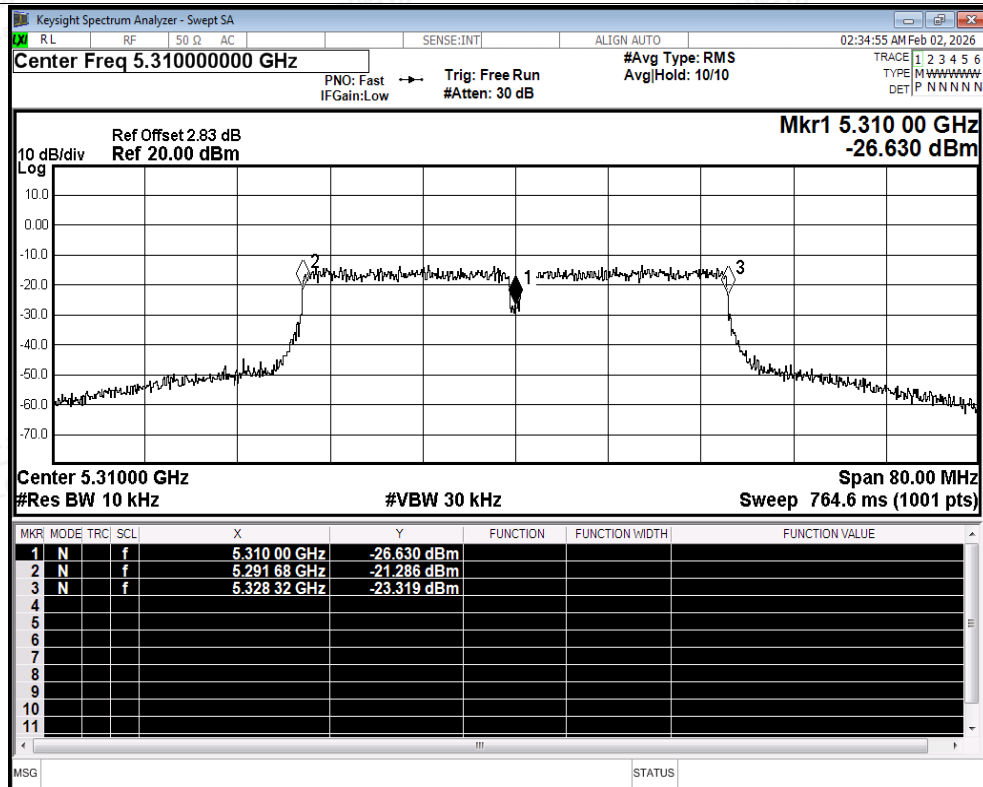

Freq. Stability NVNT n40 5310MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

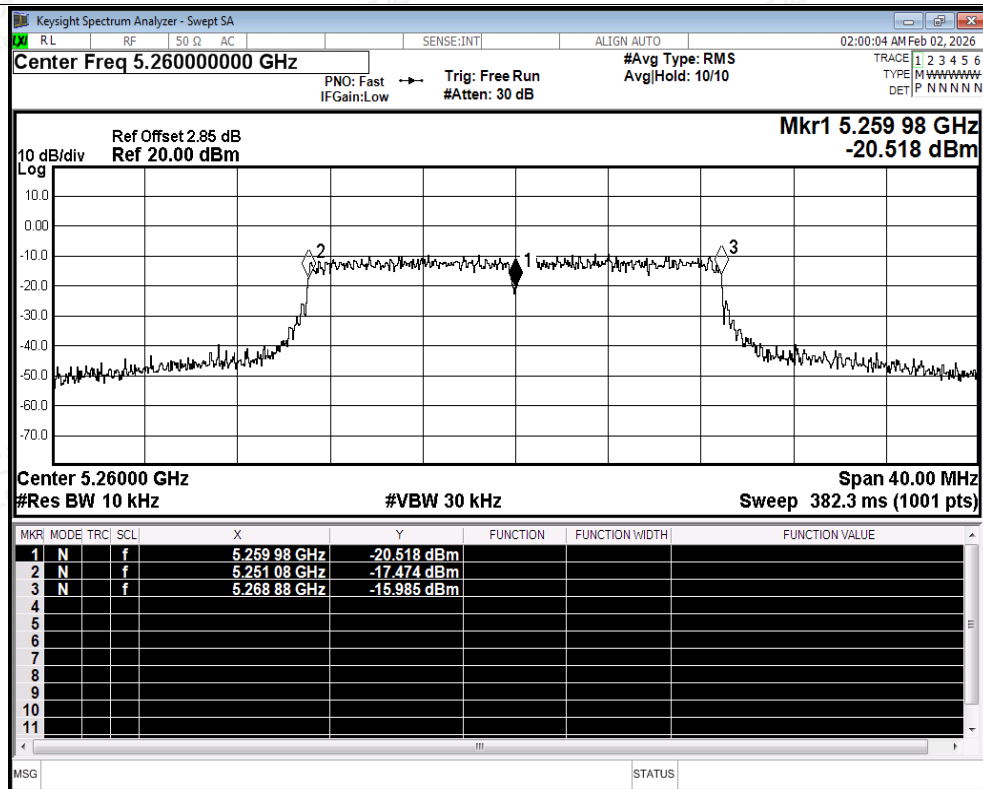

Freq. Stability NVNT ac20 5260MHz Ant2

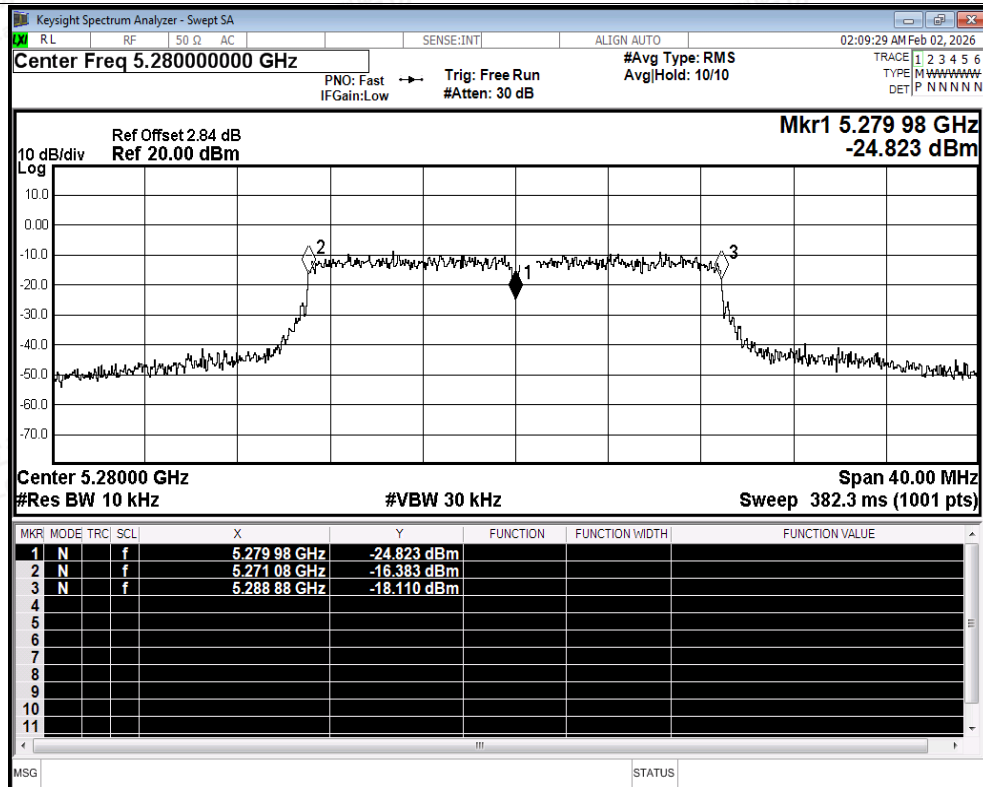

Freq. Stability NVNT ac20 5280MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

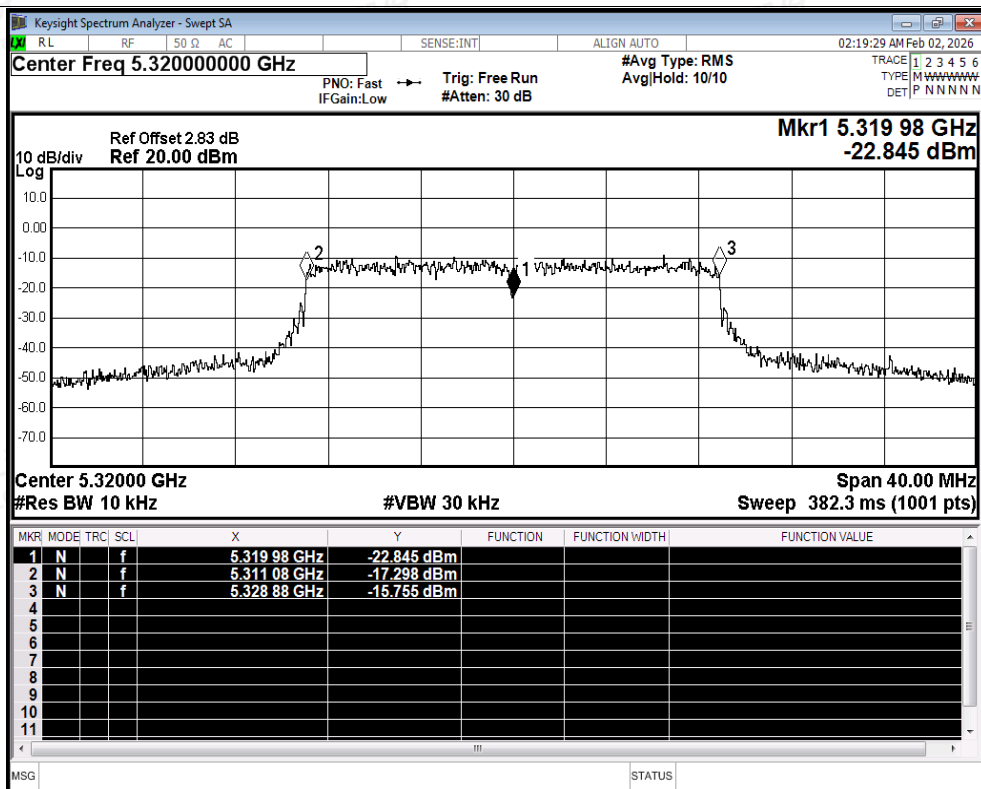

Freq. Stability NVNT ac20 5320MHz Ant2

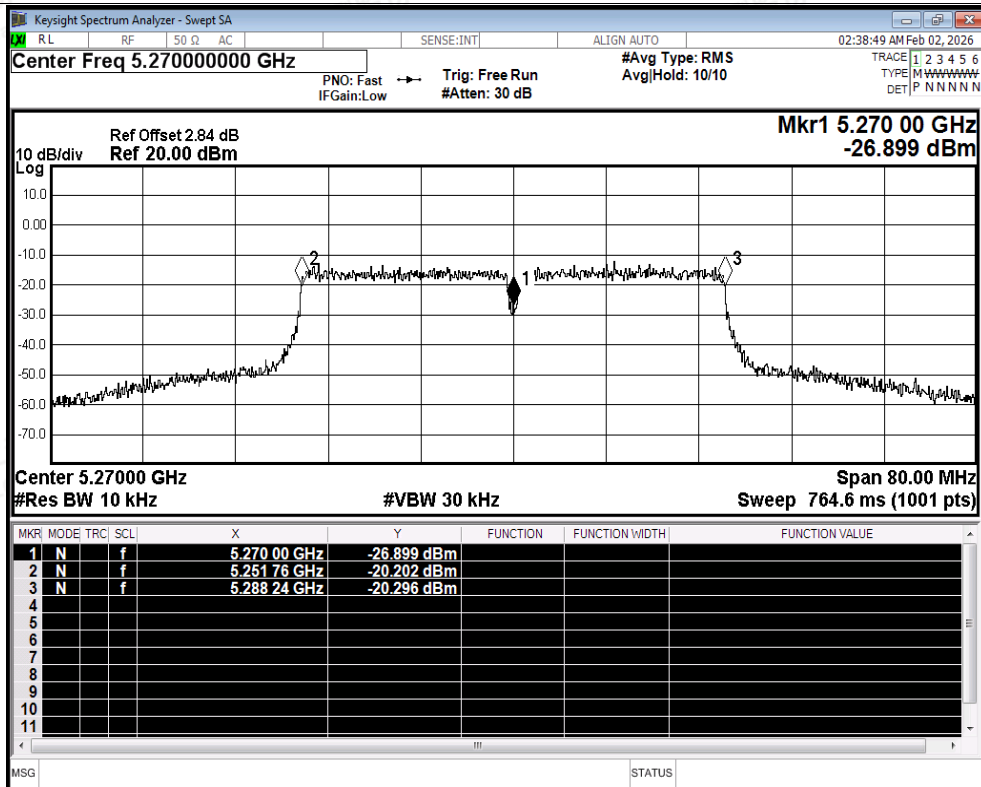

Freq. Stability NVNT ac40 5270MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

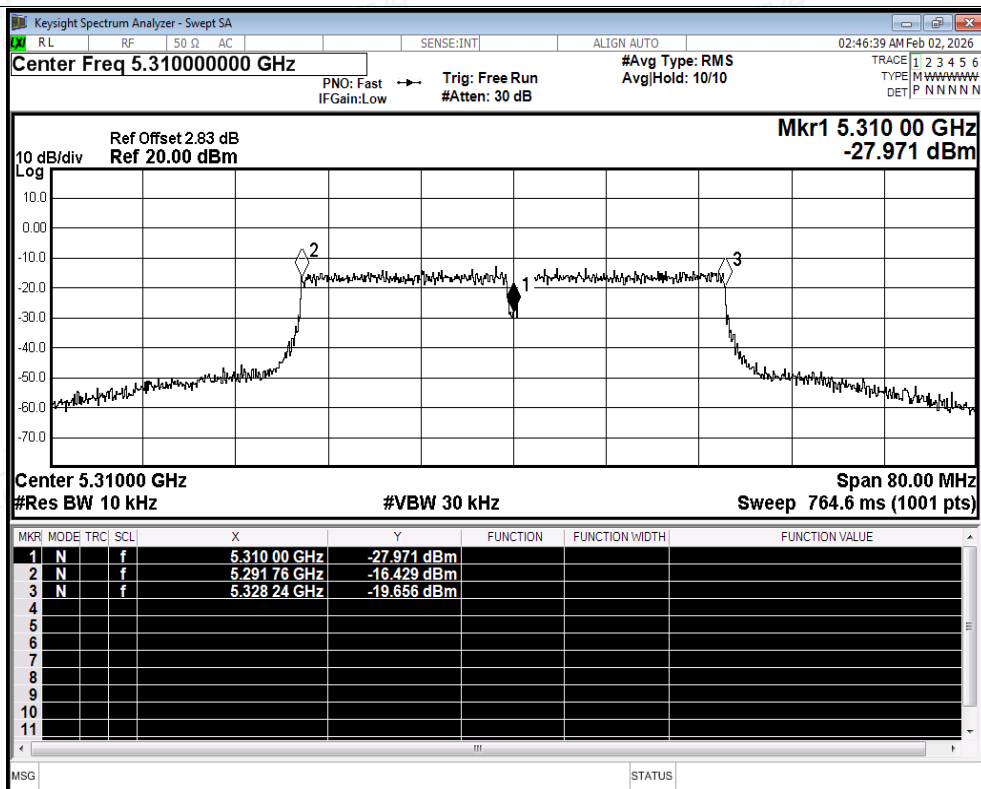

Freq. Stability NVNT ac40 5310MHz Ant2

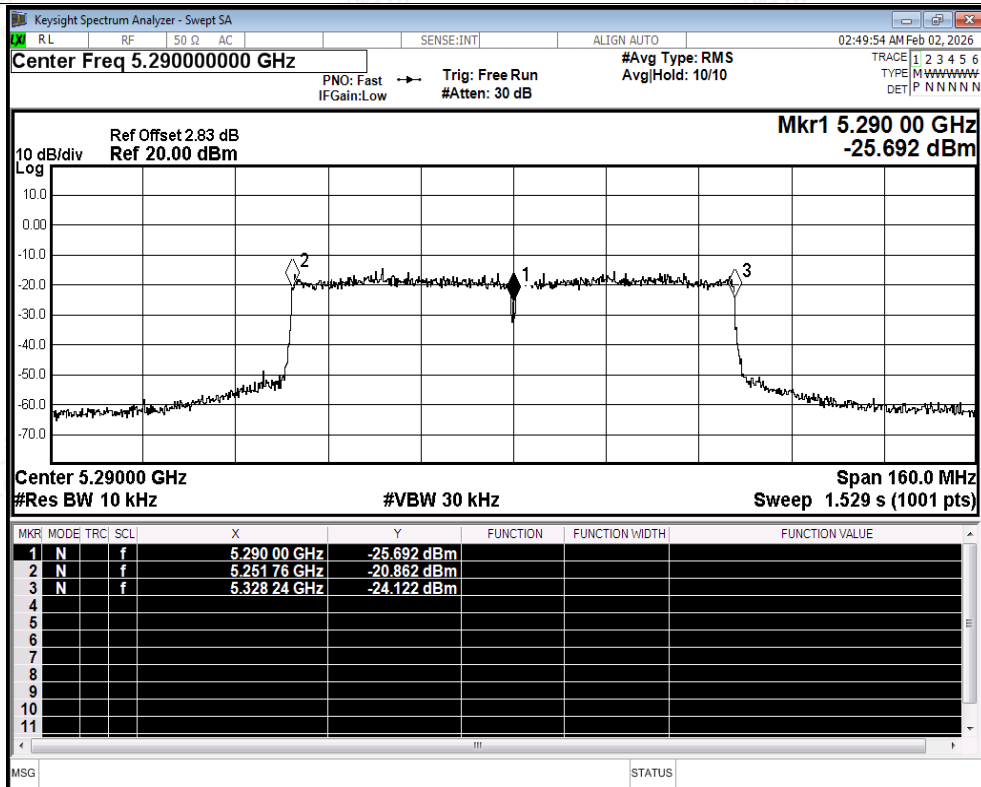

Freq. Stability NVNT ac80 5290MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

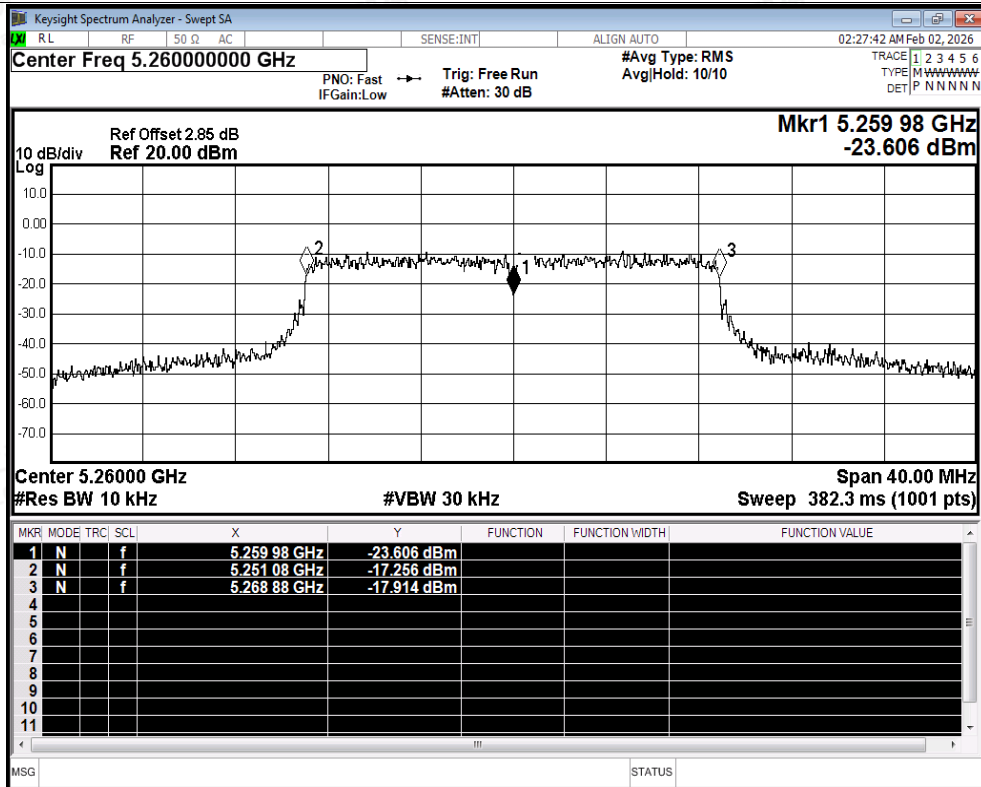

Freq. Stability NVNT ax20 5260MHz Ant2

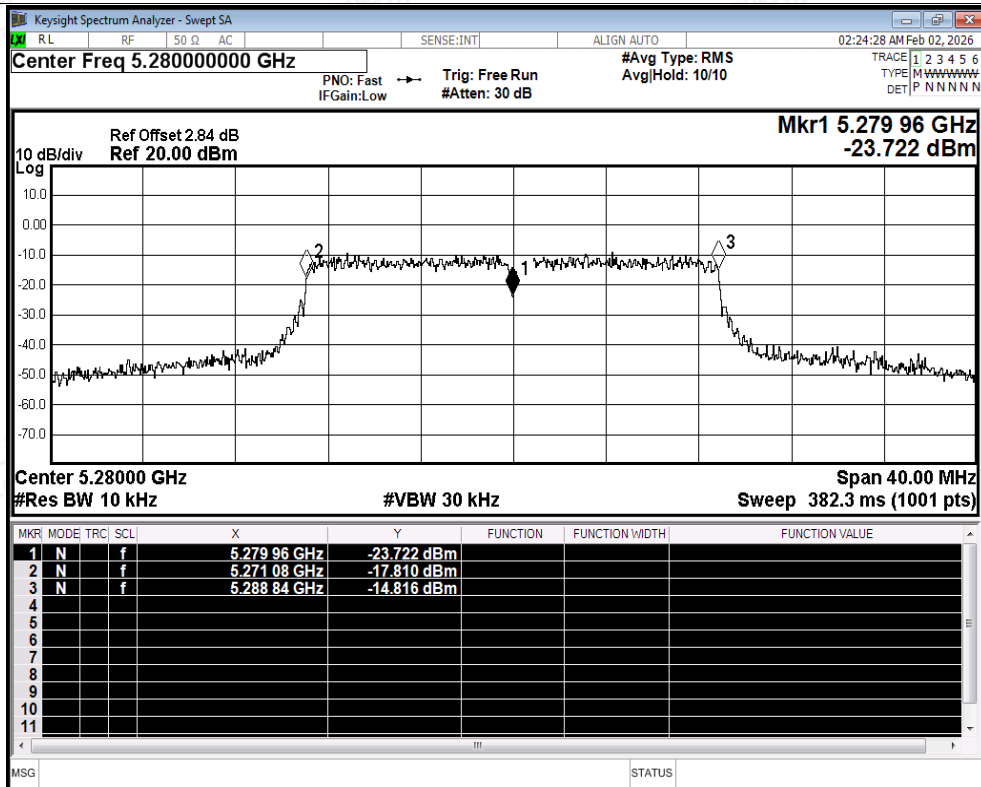

Freq. Stability NVNT ax20 5280MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

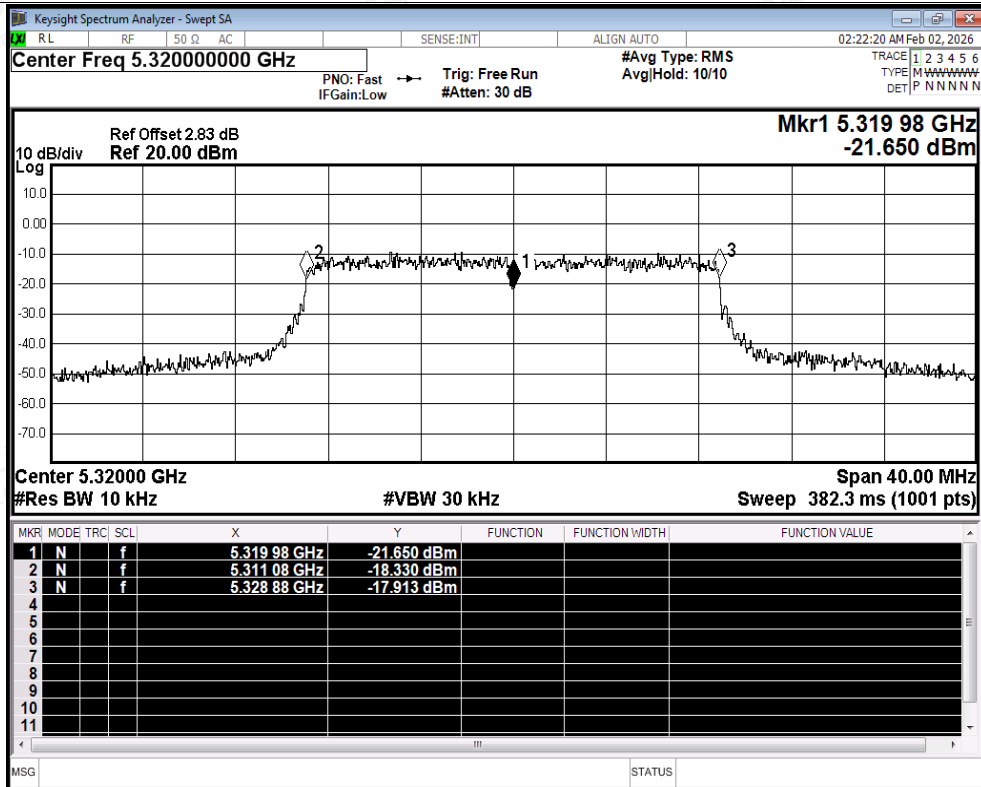

Freq. Stability NVNT ax20 5320MHz Ant2

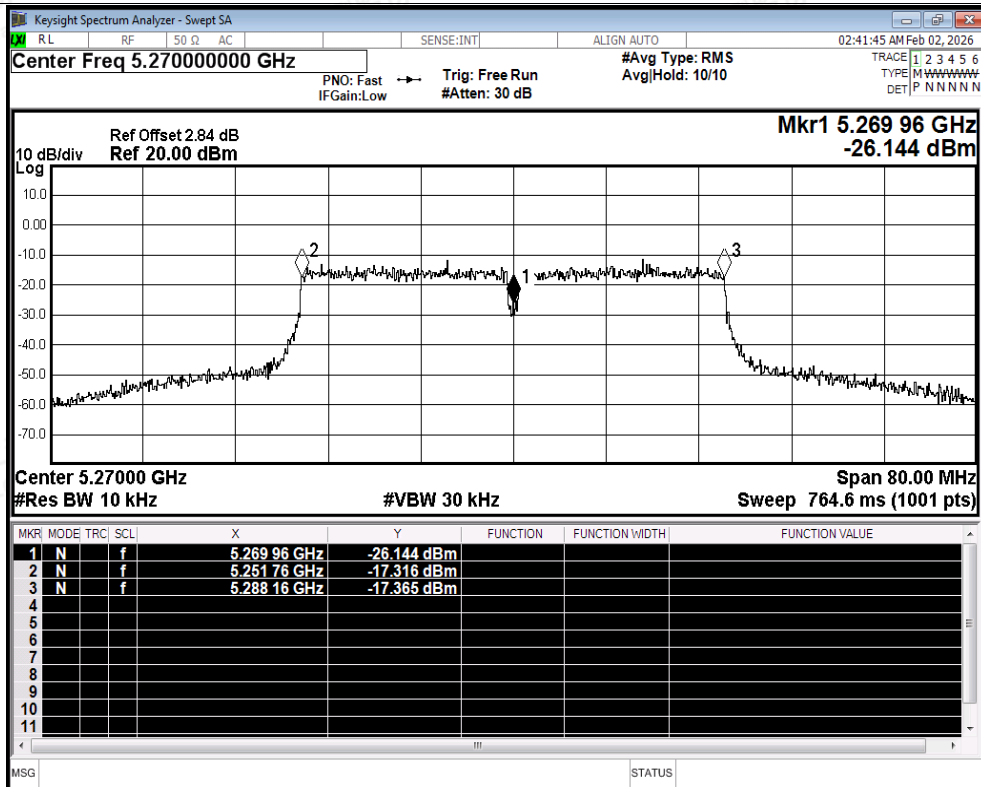

Freq. Stability NVNT ax40 5270MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

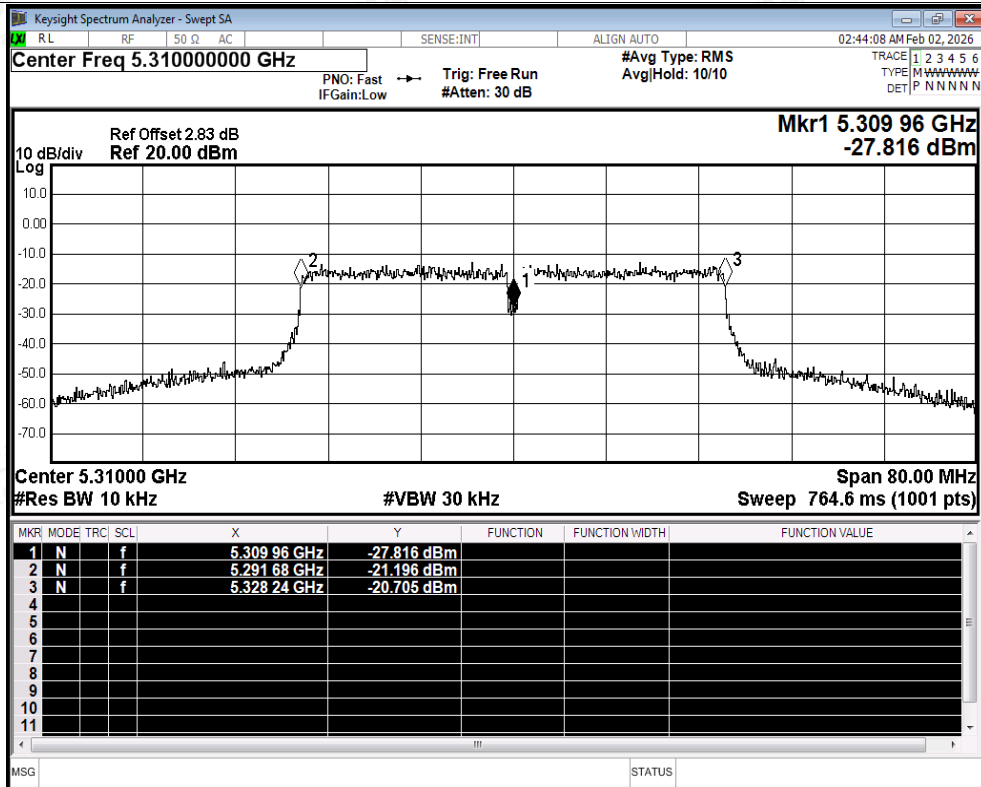

Freq. Stability NVNT ax40 5310MHz Ant2

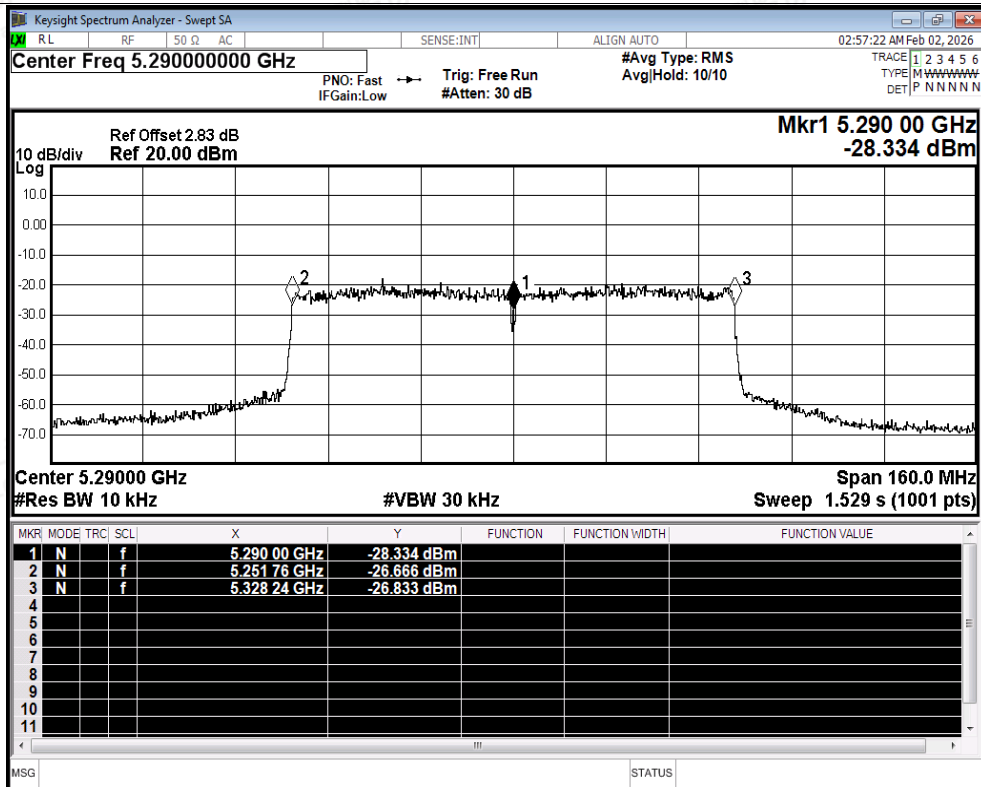

Freq. Stability NVNT ax80 5290MHz Ant2



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



E.6 Duty Cycle

Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5260	Ant1	97.46	0.11	0.37
NVNT	a	5280	Ant1	97.83	0.1	0.37
NVNT	a	5320	Ant1	97.83	0.1	0.37
NVNT	n20	5260	Ant1	97	0.13	0.44
NVNT	n20	5280	Ant1	97.41	0.11	0.44
NVNT	n20	5320	Ant1	97.42	0.11	0.44
NVNT	n40	5270	Ant1	94.87	0.23	0.9
NVNT	n40	5310	Ant1	94.87	0.23	0.9
NVNT	ac20	5260	Ant1	97.42	0.11	0.44
NVNT	ac20	5280	Ant1	97.42	0.11	0.44
NVNT	ac20	5320	Ant1	97.42	0.11	0.44
NVNT	ac40	5270	Ant1	94.87	0.23	0.9
NVNT	ac40	5310	Ant1	94.87	0.23	0.9
NVNT	ac80	5290	Ant1	88.33	0.54	1.89
NVNT	ax20	5260	Ant1	97.42	0.11	0.44
NVNT	ax20	5280	Ant1	97.42	0.11	0.44
NVNT	ax20	5320	Ant1	97.42	0.11	0.44
NVNT	ax40	5270	Ant1	94.87	0.23	0.9
NVNT	ax40	5310	Ant1	94.92	0.23	0.89
NVNT	ax80	5290	Ant1	88.33	0.54	1.89




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

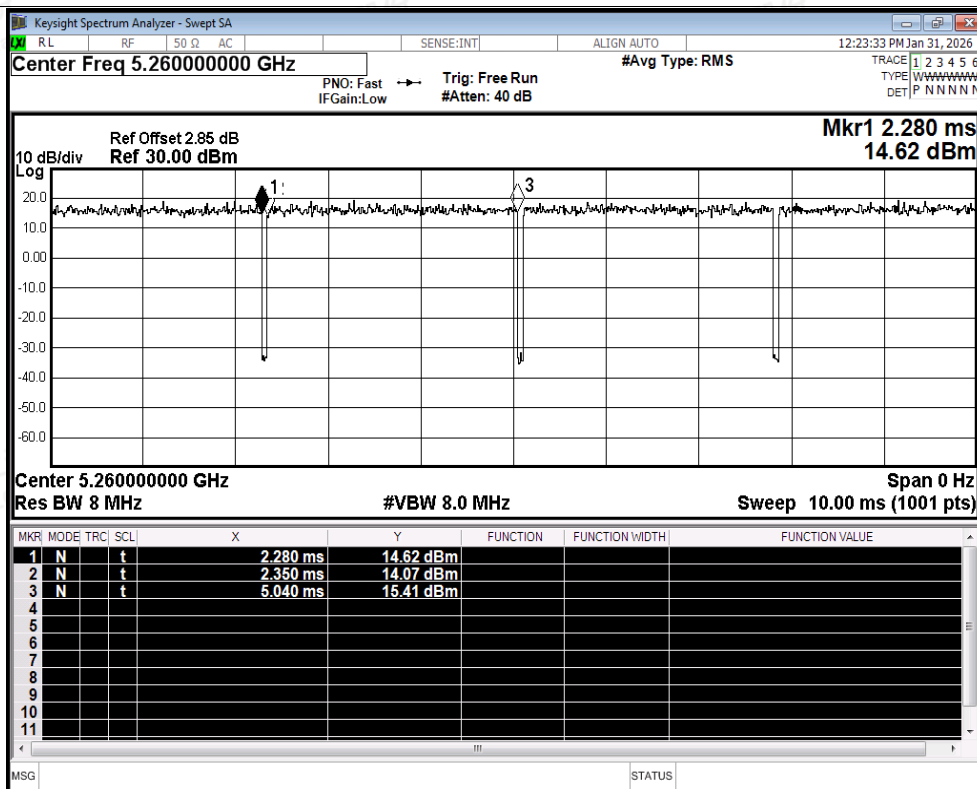

Duty Cycle NVNT a 5260MHz Ant1

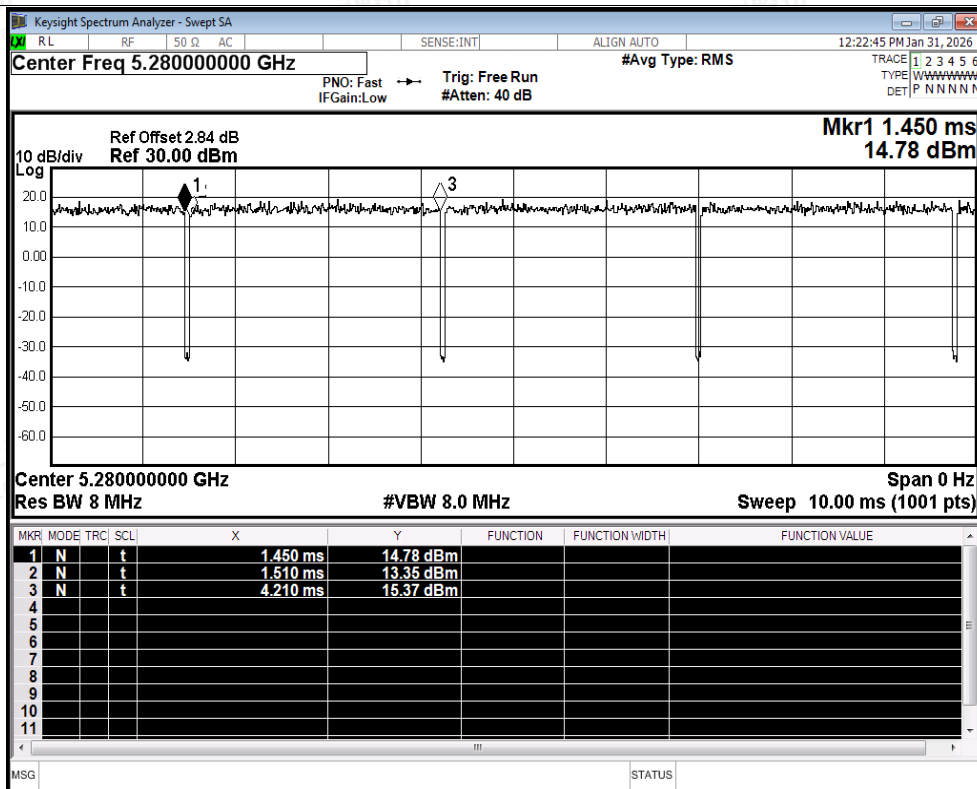

Duty Cycle NVNT a 5280MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

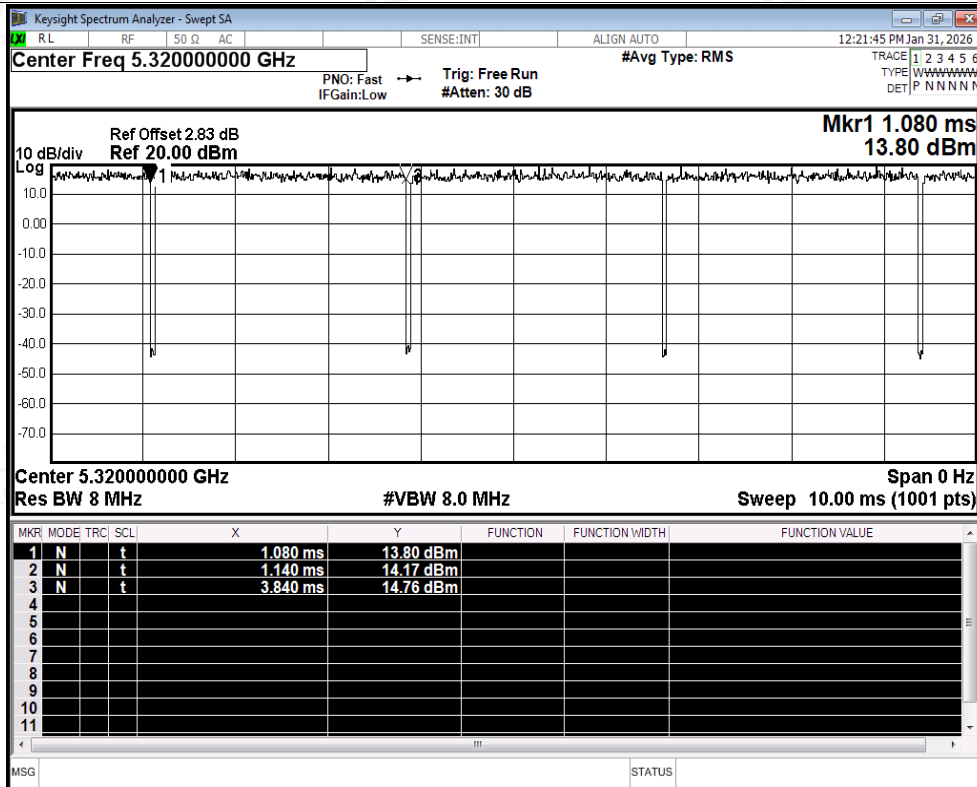

Duty Cycle NVNT a 5320MHz Ant1

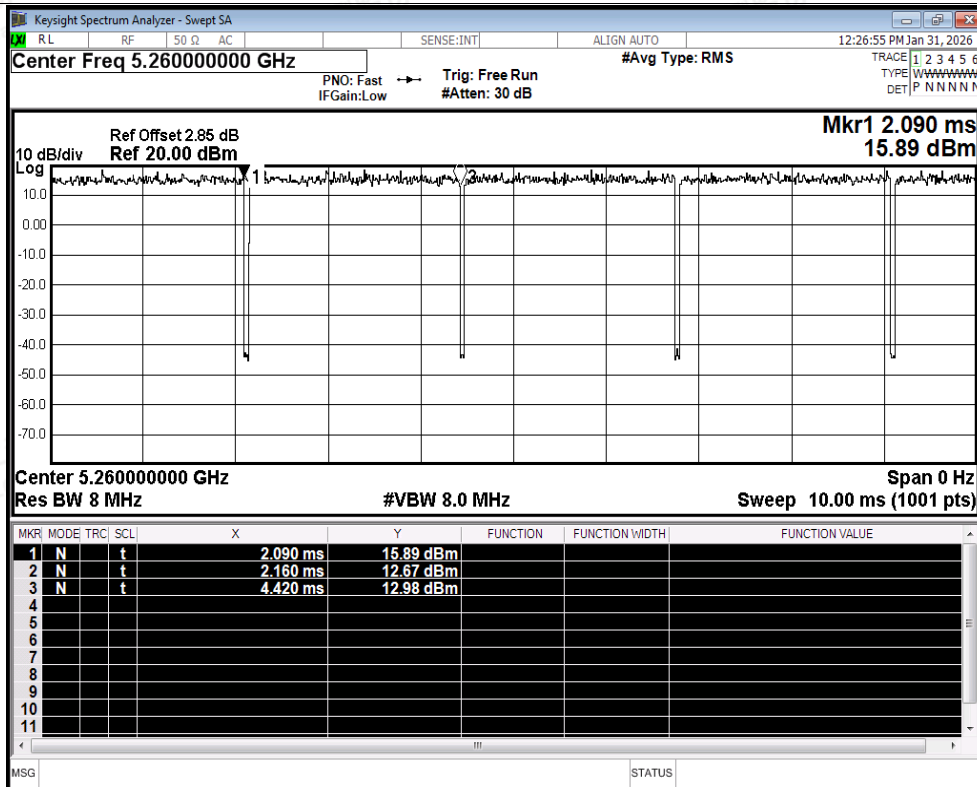

Duty Cycle NVNT n20 5260MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

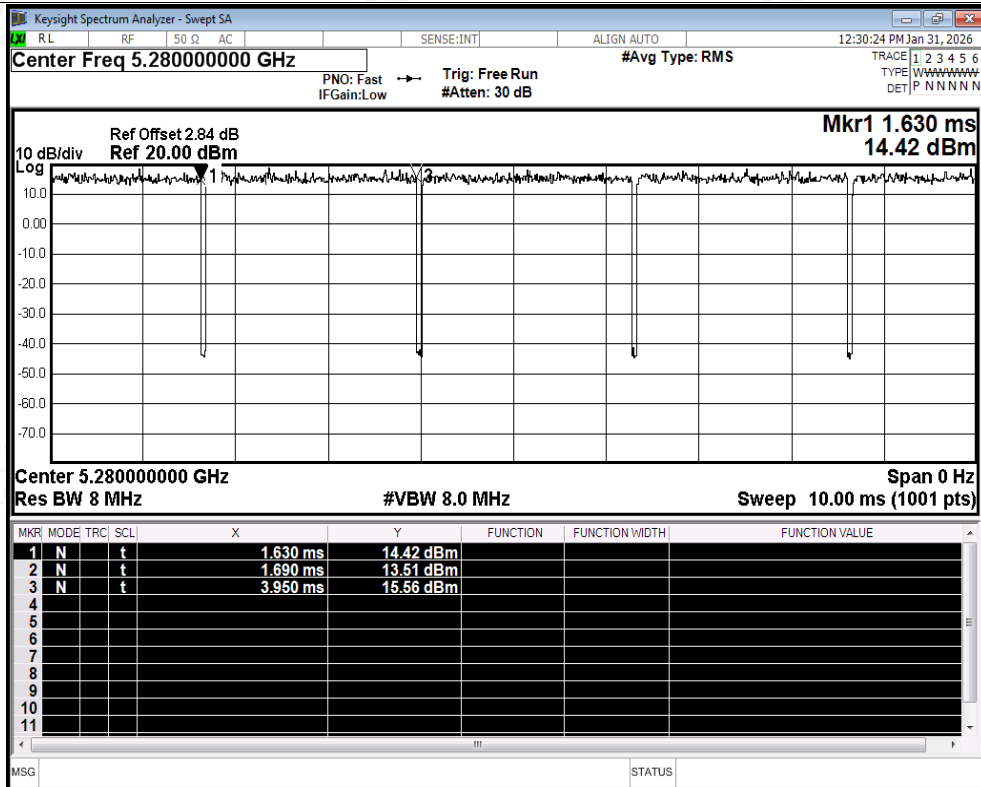

Duty Cycle NVNT n20 5280MHz Ant1

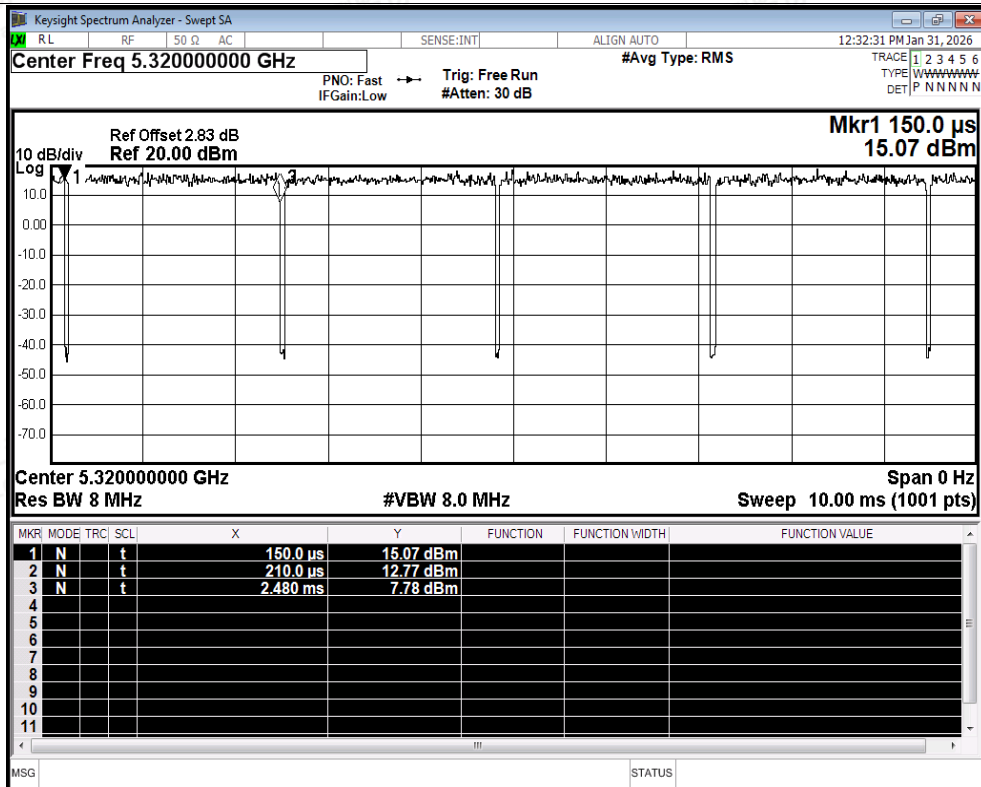

Duty Cycle NVNT n20 5320MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

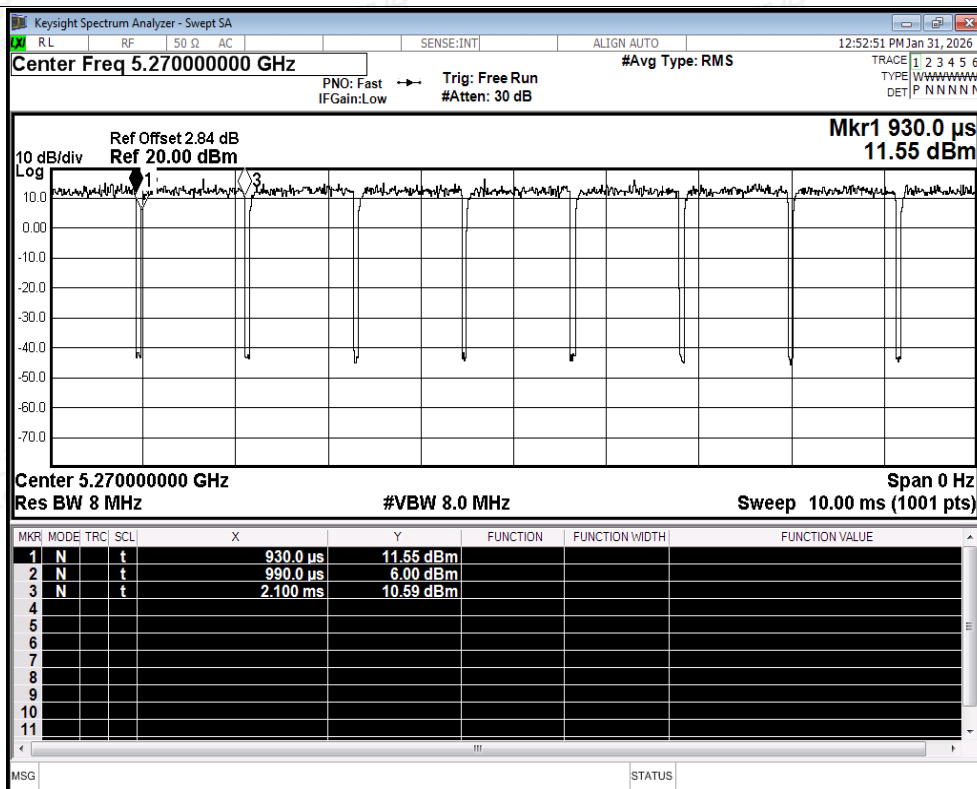

Duty Cycle NVNT n40 5270MHz Ant1

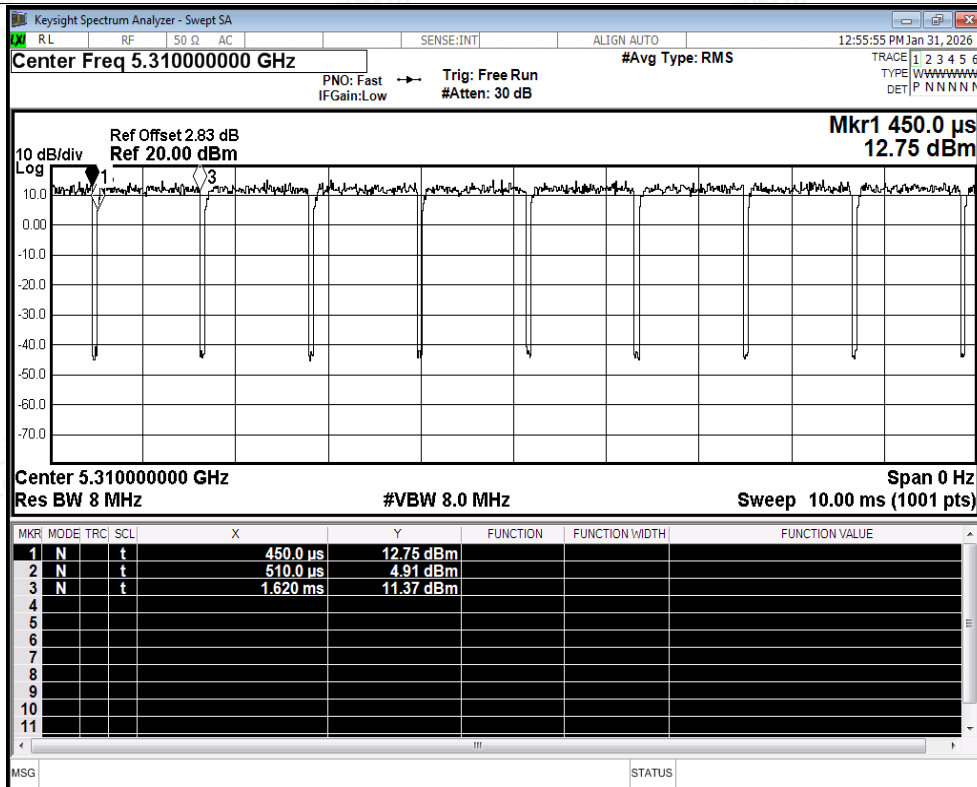

Duty Cycle NVNT n40 5310MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

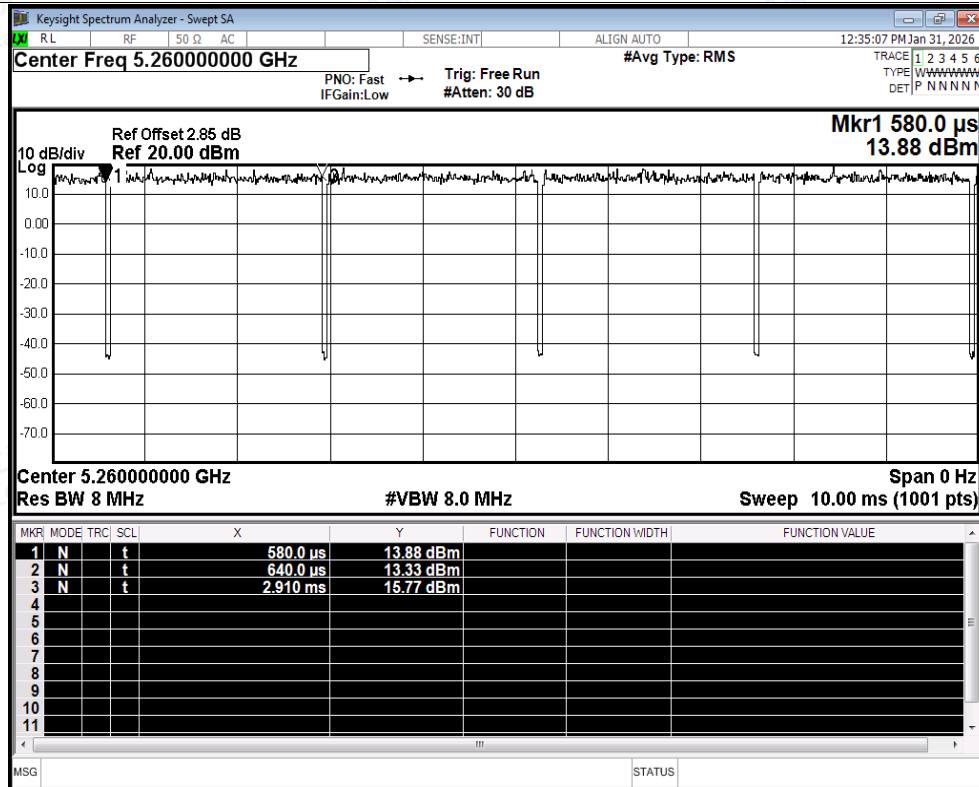

Duty Cycle NVNT ac20 5260MHz Ant1

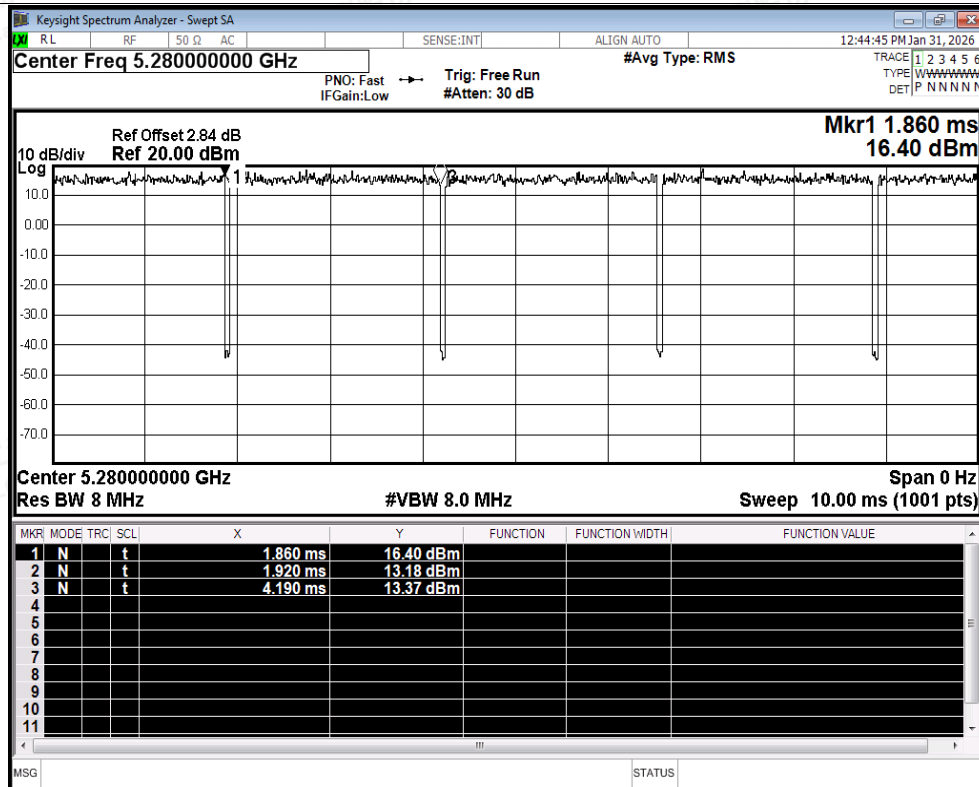

Duty Cycle NVNT ac20 5280MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

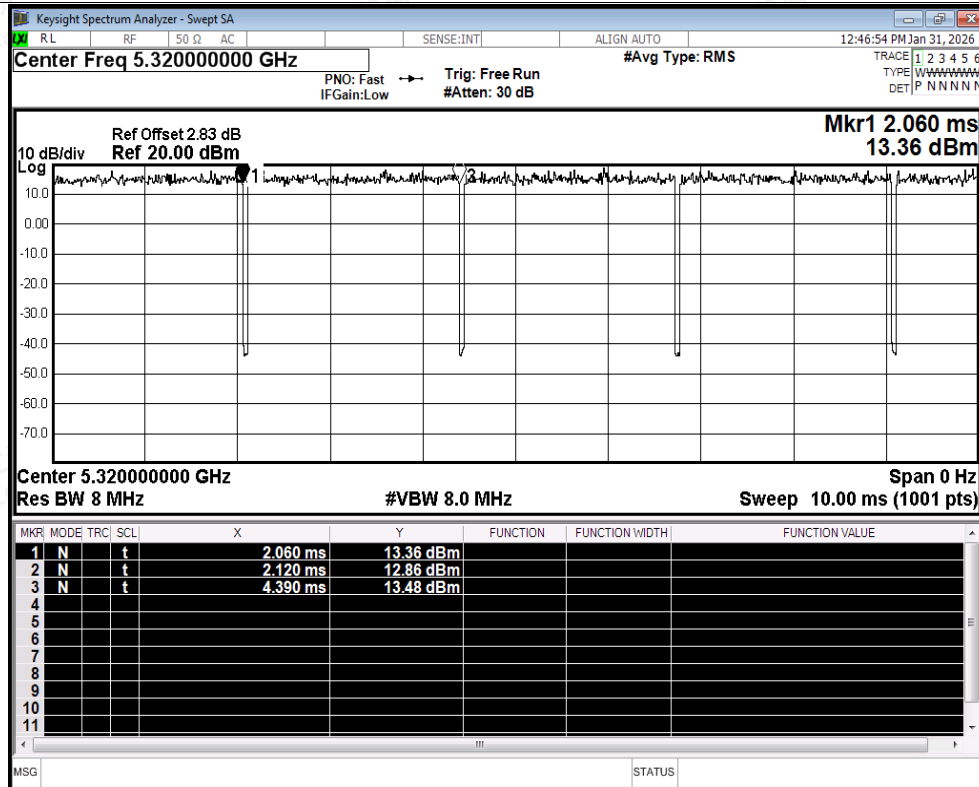

Duty Cycle NVNT ac20 5320MHz Ant1

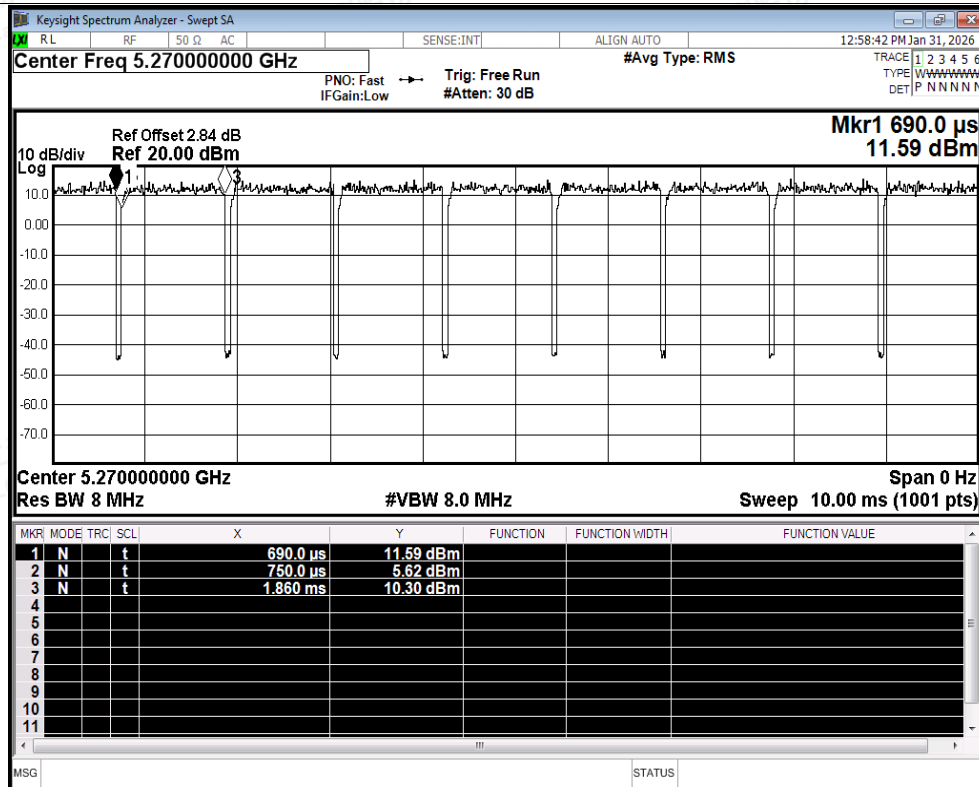

Duty Cycle NVNT ac40 5270MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

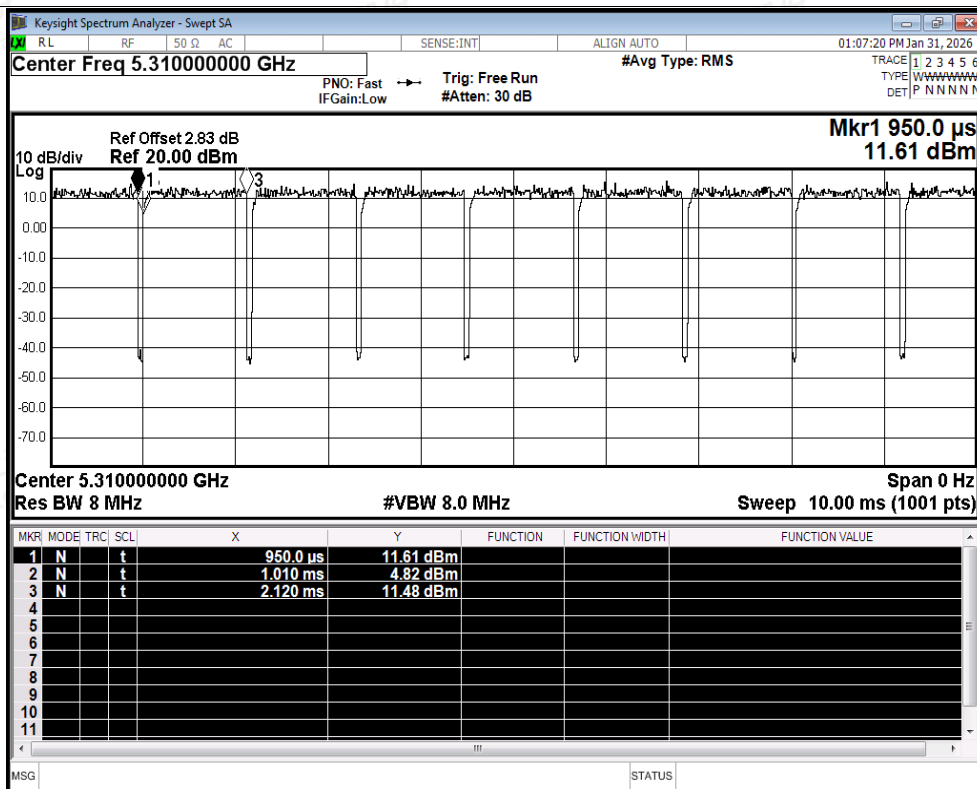

Duty Cycle NVNT ac40 5310MHz Ant1

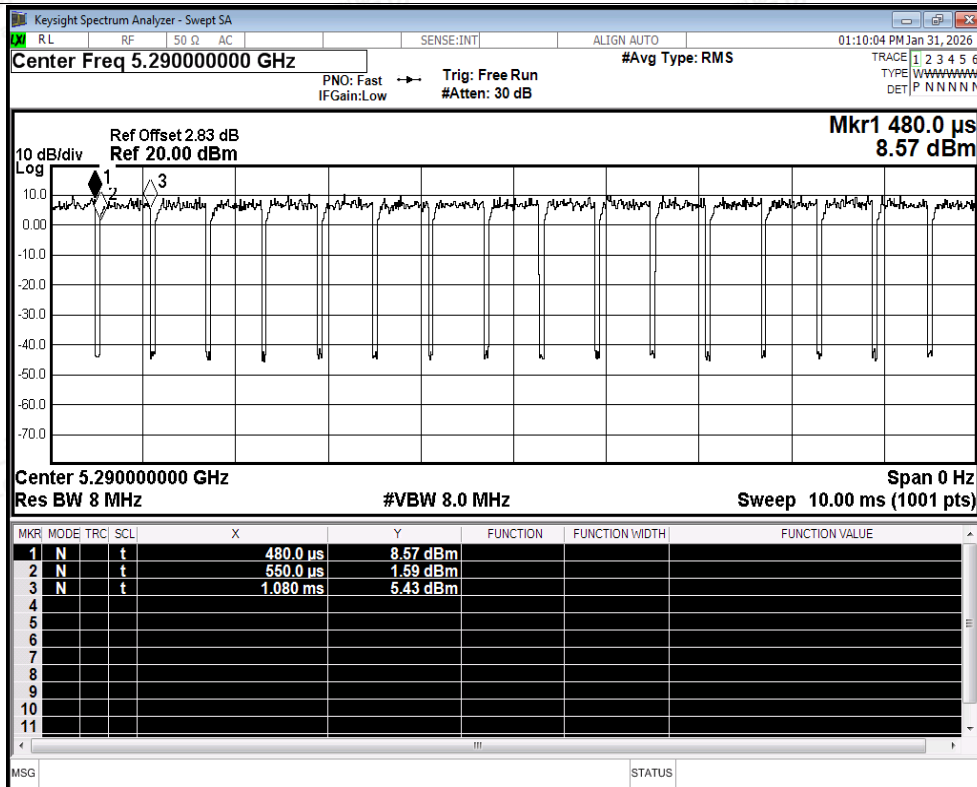

Duty Cycle NVNT ac80 5290MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

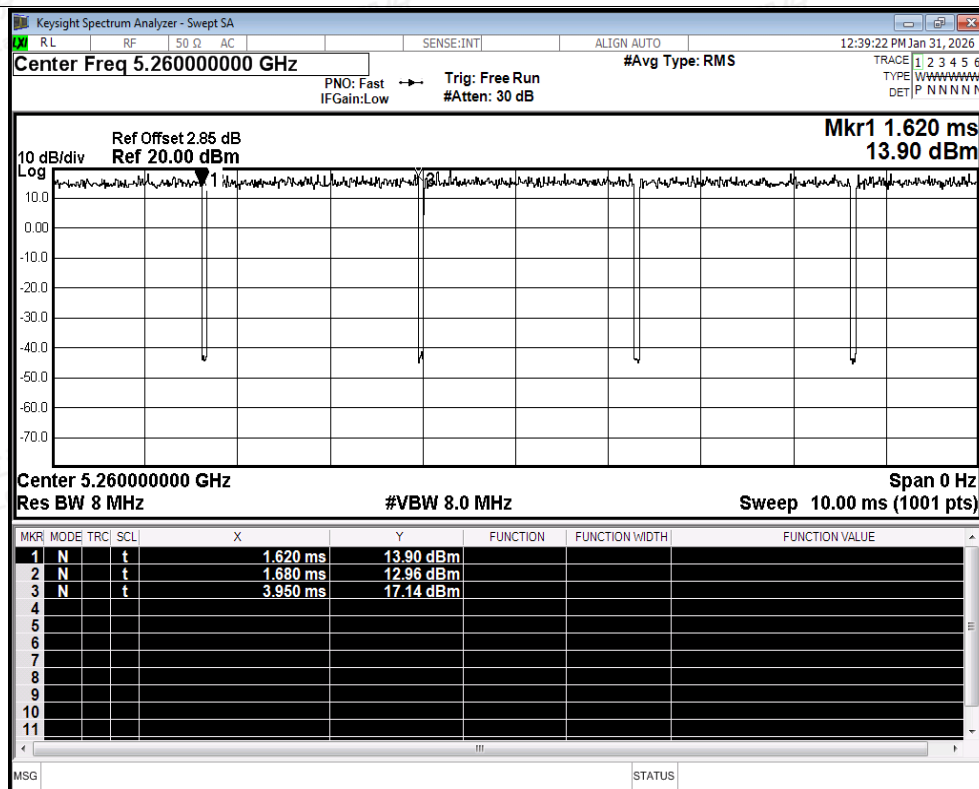

Duty Cycle NVNT ax20 5260MHz Ant1

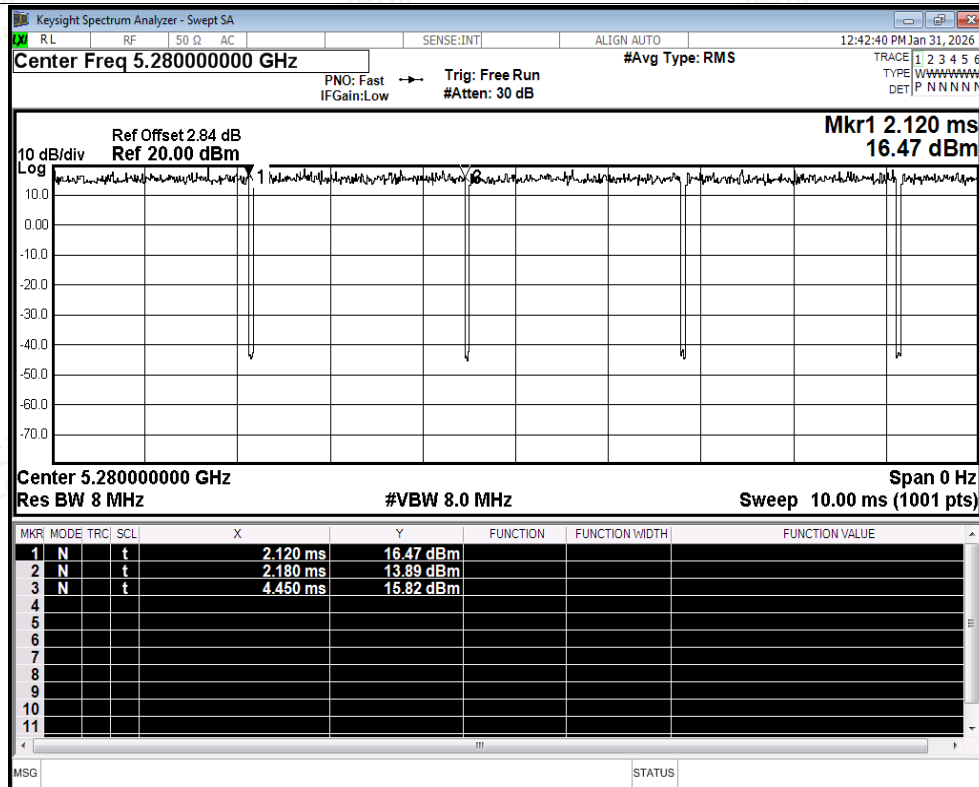

Duty Cycle NVNT ax20 5280MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

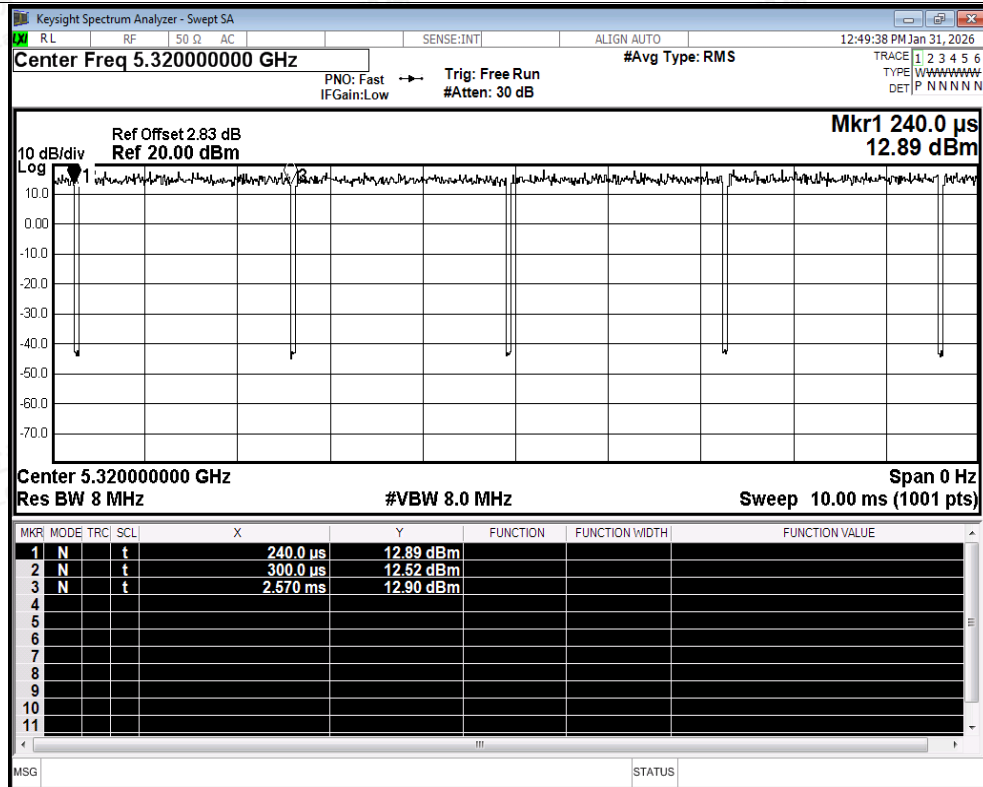

Duty Cycle NVNT ax20 5320MHz Ant1

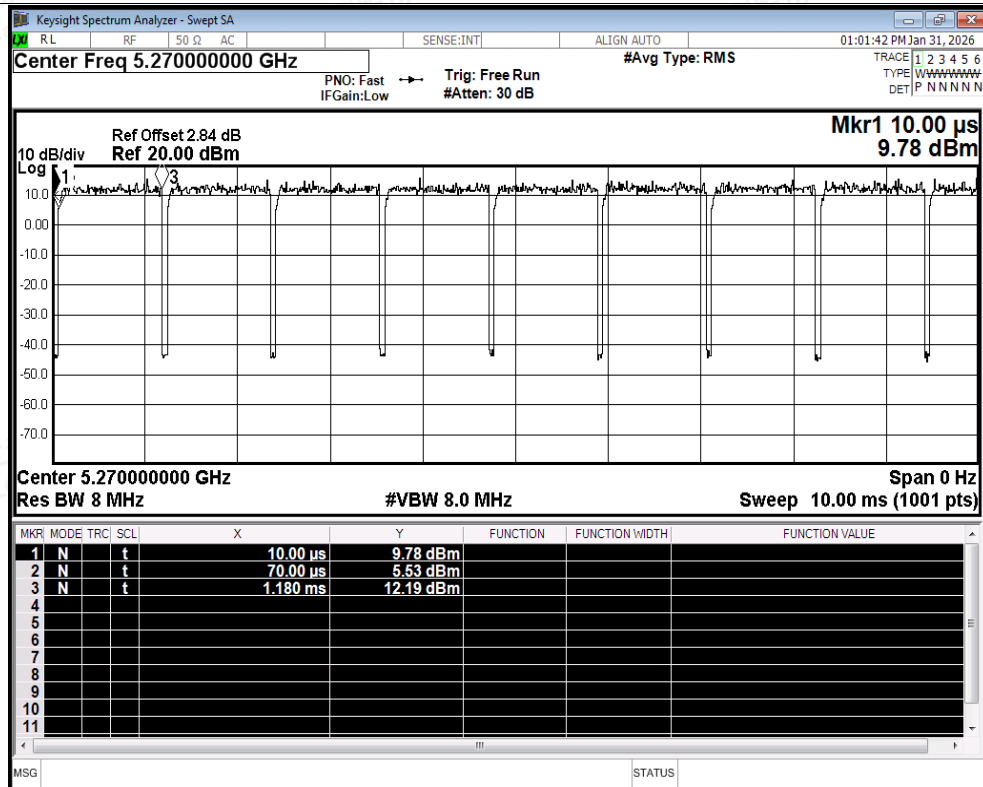

Duty Cycle NVNT ax40 5270MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

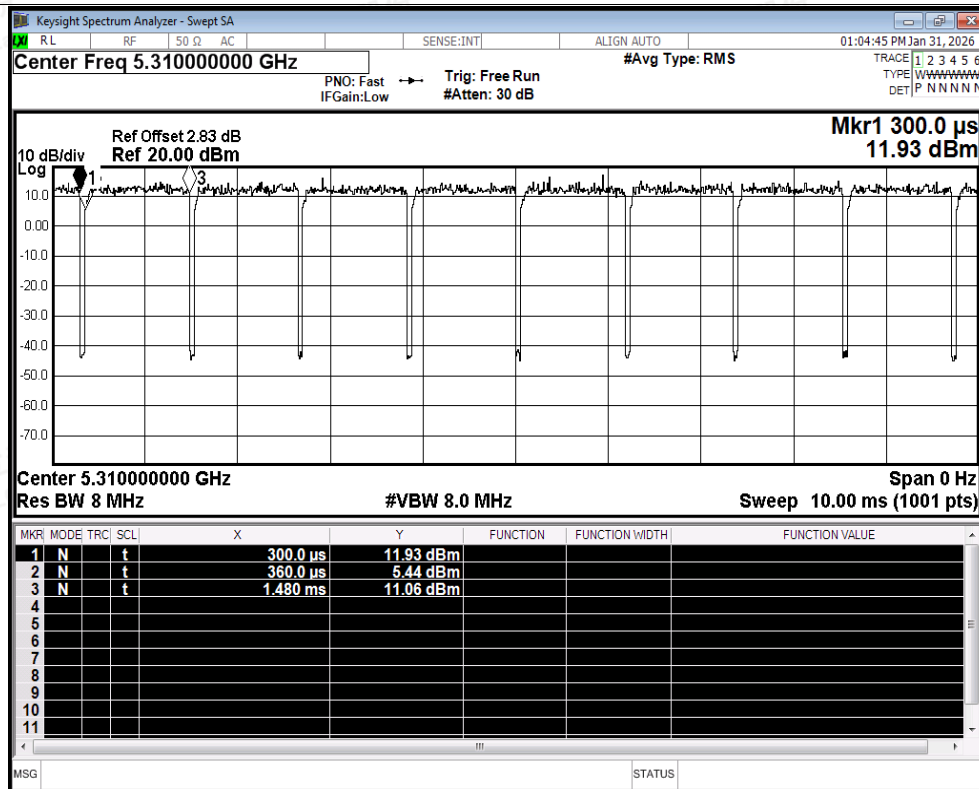

Duty Cycle NVNT ax40 5310MHz Ant1

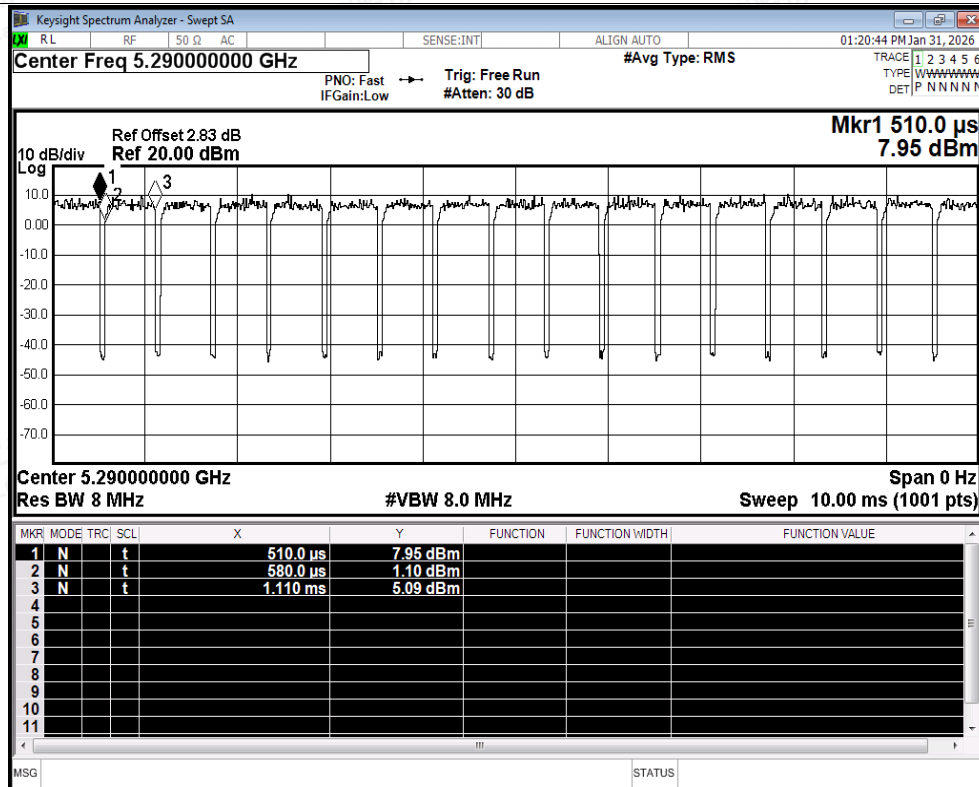

Duty Cycle NVNT ax80 5290MHz Ant1



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5260	Ant2	97.83	0.1	0.37
NVNT	a	5280	Ant2	97.83	0.1	0.37
NVNT	a	5320	Ant2	97.46	0.11	0.37
NVNT	n20	5260	Ant2	97.41	0.11	0.44
NVNT	n20	5280	Ant2	97.41	0.11	0.44
NVNT	n20	5320	Ant2	97	0.13	0.44
NVNT	n40	5270	Ant2	94.02	0.27	0.91
NVNT	n40	5310	Ant2	94.07	0.27	0.9
NVNT	ac20	5260	Ant2	97.42	0.11	0.44
NVNT	ac20	5280	Ant2	97	0.13	0.44
NVNT	ac20	5320	Ant2	97.42	0.11	0.44
NVNT	ac40	5270	Ant2	94.87	0.23	0.9
NVNT	ac40	5310	Ant2	94.87	0.23	0.9
NVNT	ac80	5290	Ant2	88.33	0.54	1.89
NVNT	ax20	5260	Ant2	97.42	0.11	0.44
NVNT	ax20	5280	Ant2	97.42	0.11	0.44
NVNT	ax20	5320	Ant2	97.42	0.11	0.44
NVNT	ax40	5270	Ant2	94.87	0.23	0.9
NVNT	ax40	5310	Ant2	94.87	0.23	0.9
NVNT	ax80	5290	Ant2	90	0.46	1.85




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

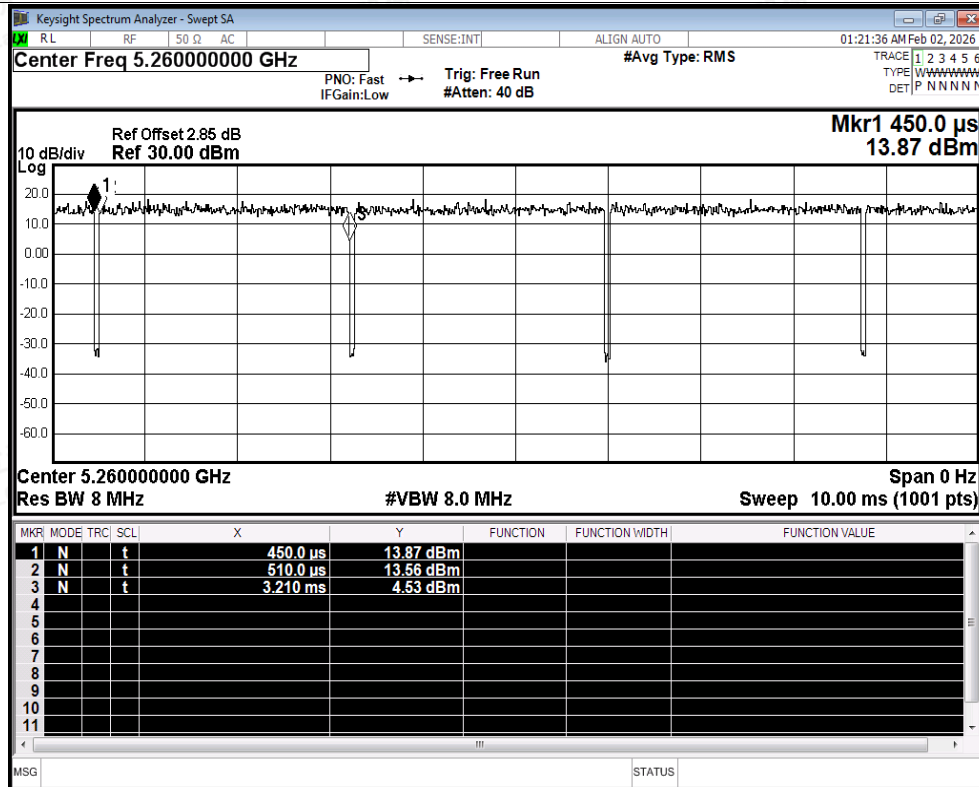

Duty Cycle NVNT a 5260MHz Ant2

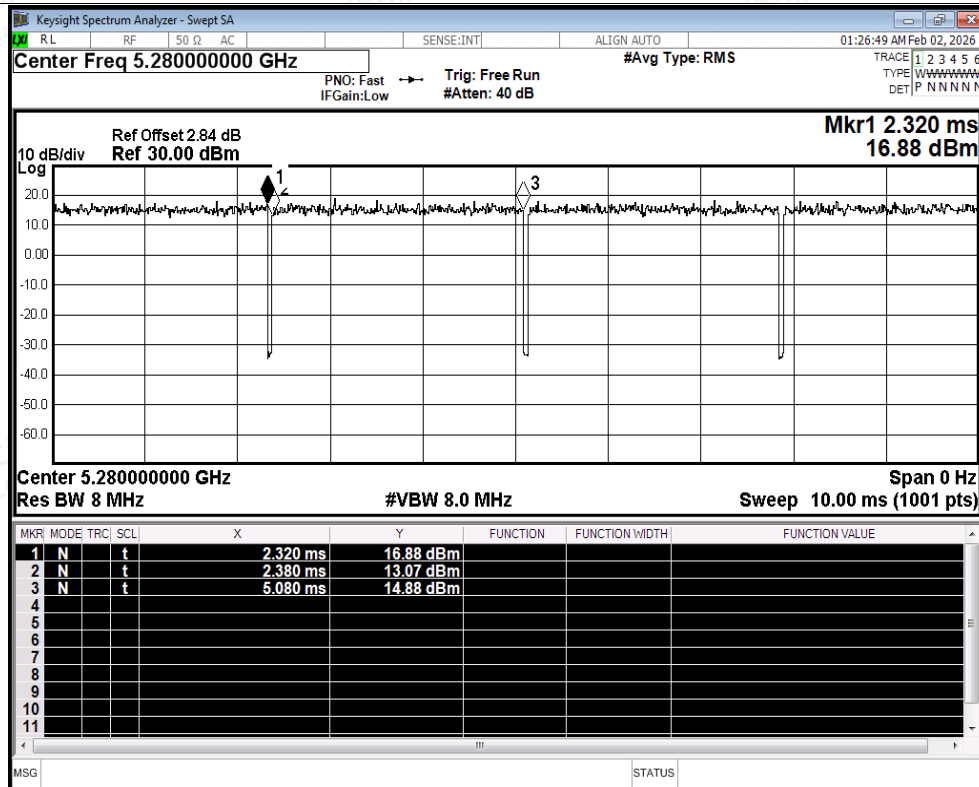

Duty Cycle NVNT a 5280MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

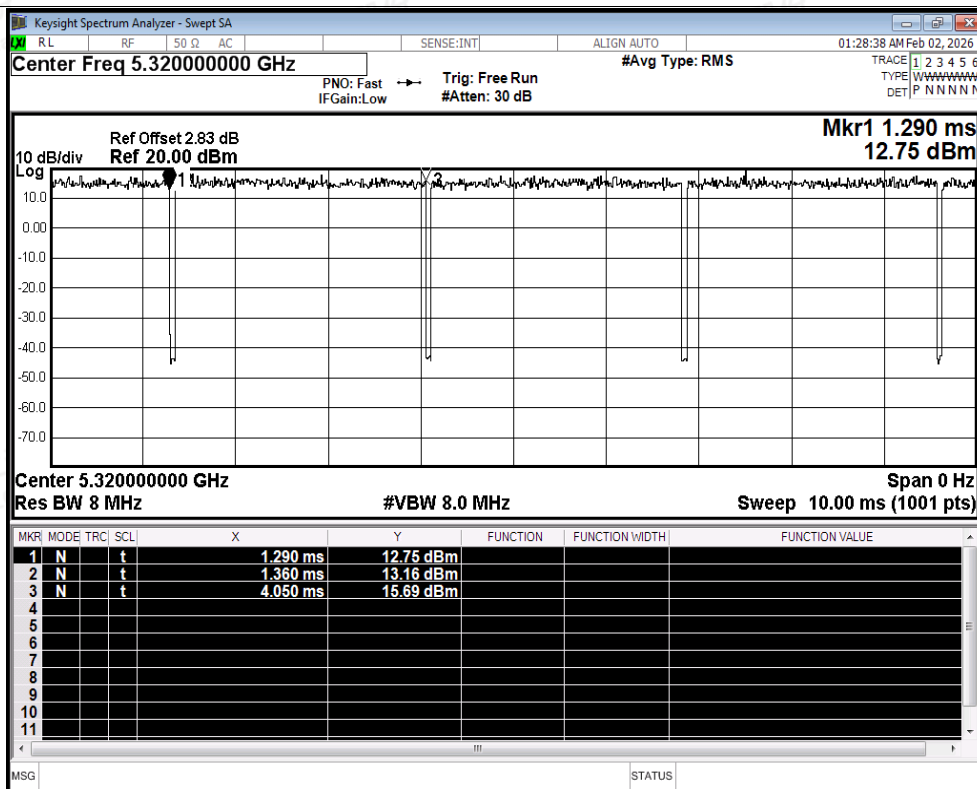

Duty Cycle NVNT a 5320MHz Ant2

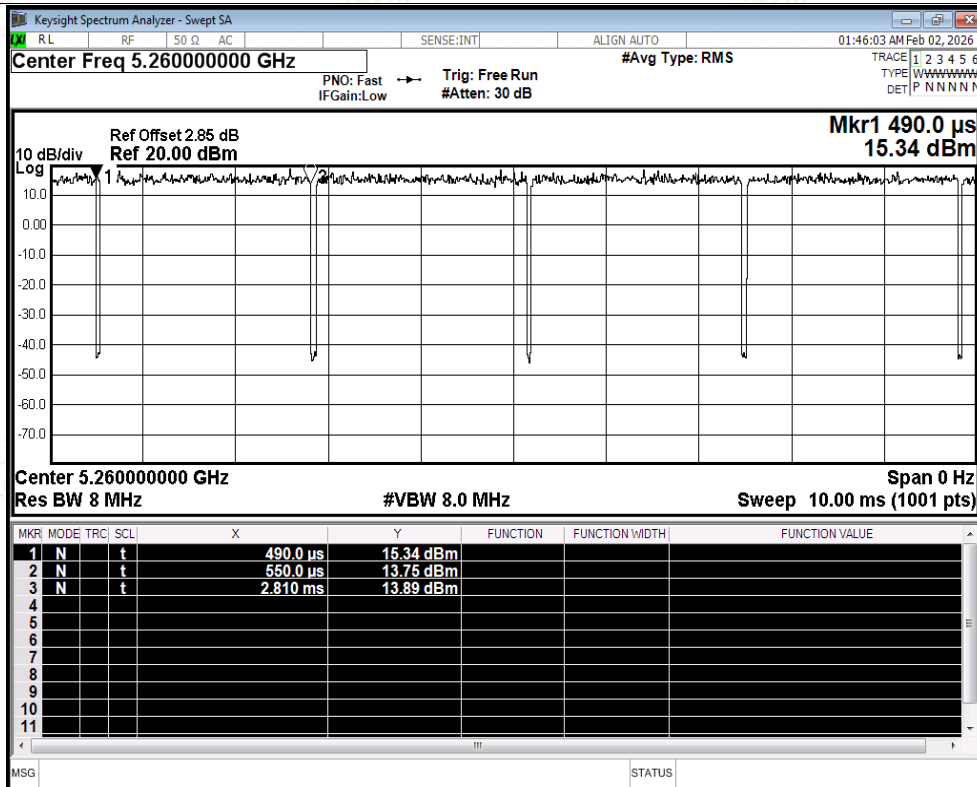

Duty Cycle NVNT n20 5260MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

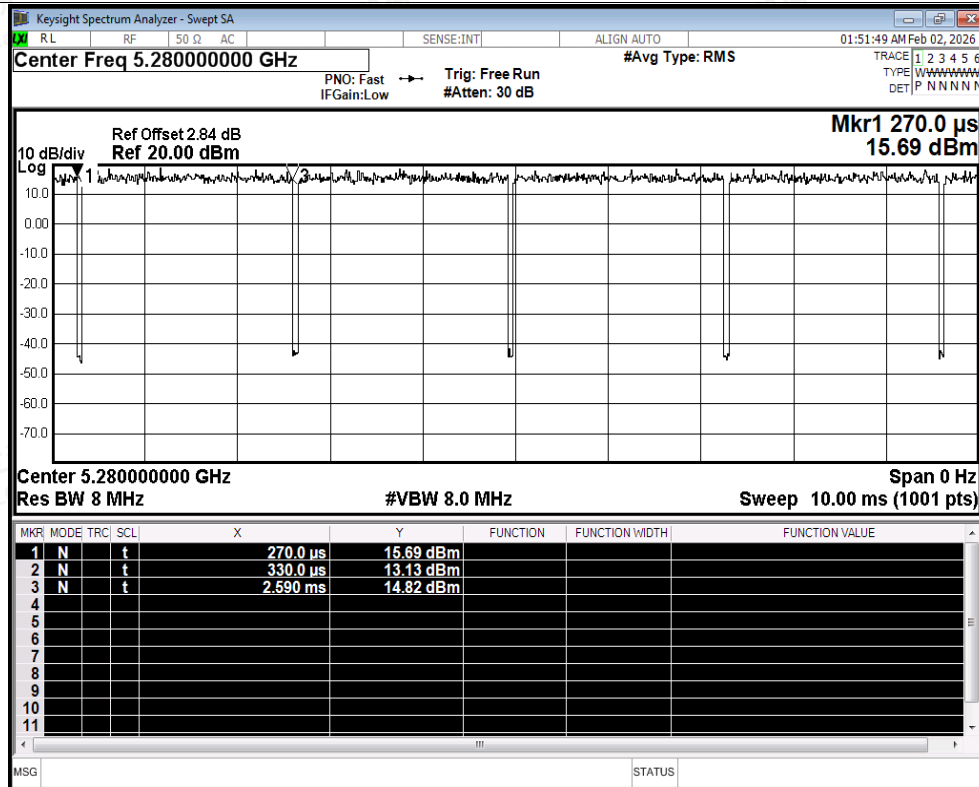

Duty Cycle NVNT n20 5280MHz Ant2

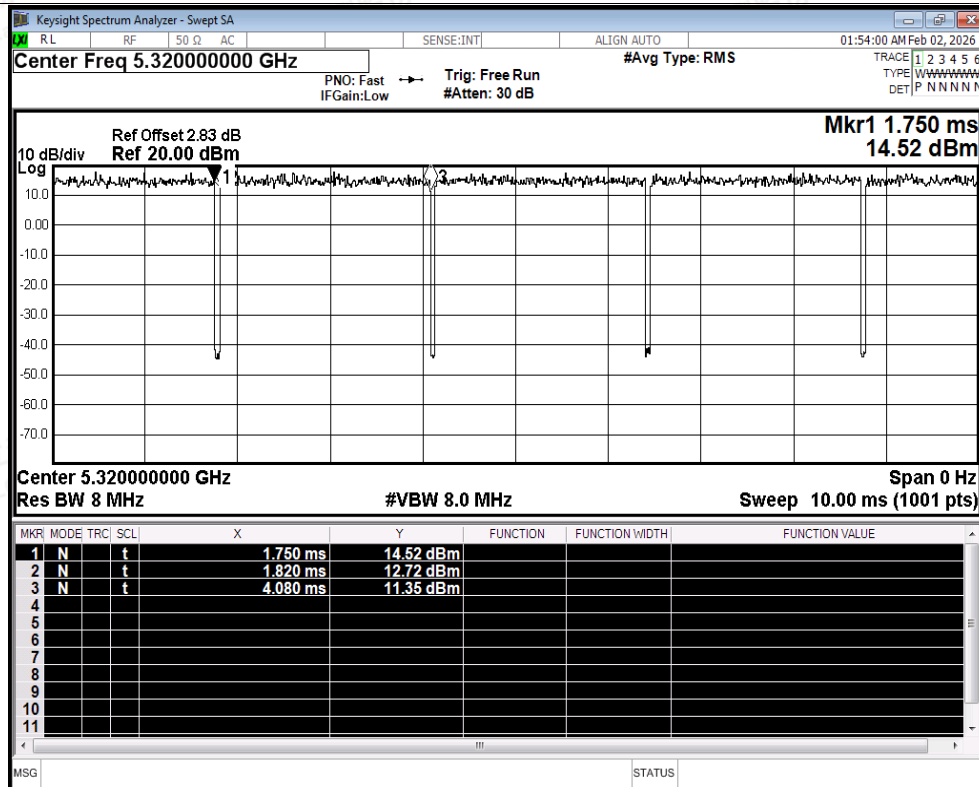

Duty Cycle NVNT n20 5320MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

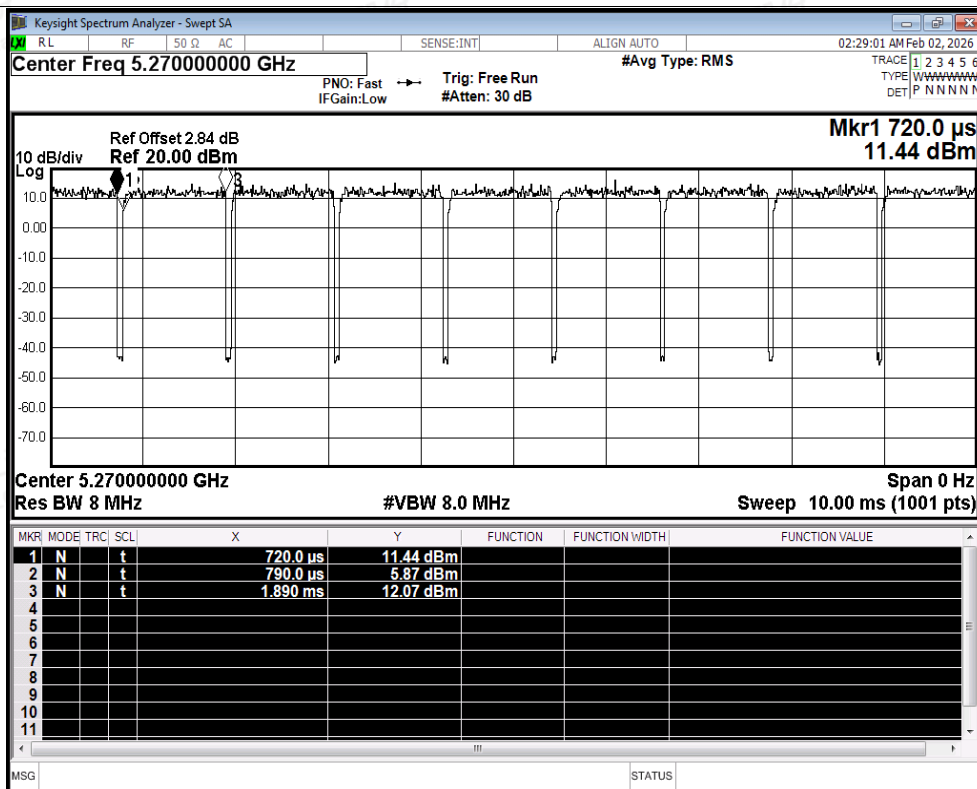


Duty Cycle NVNT n40 5270MHz Ant2

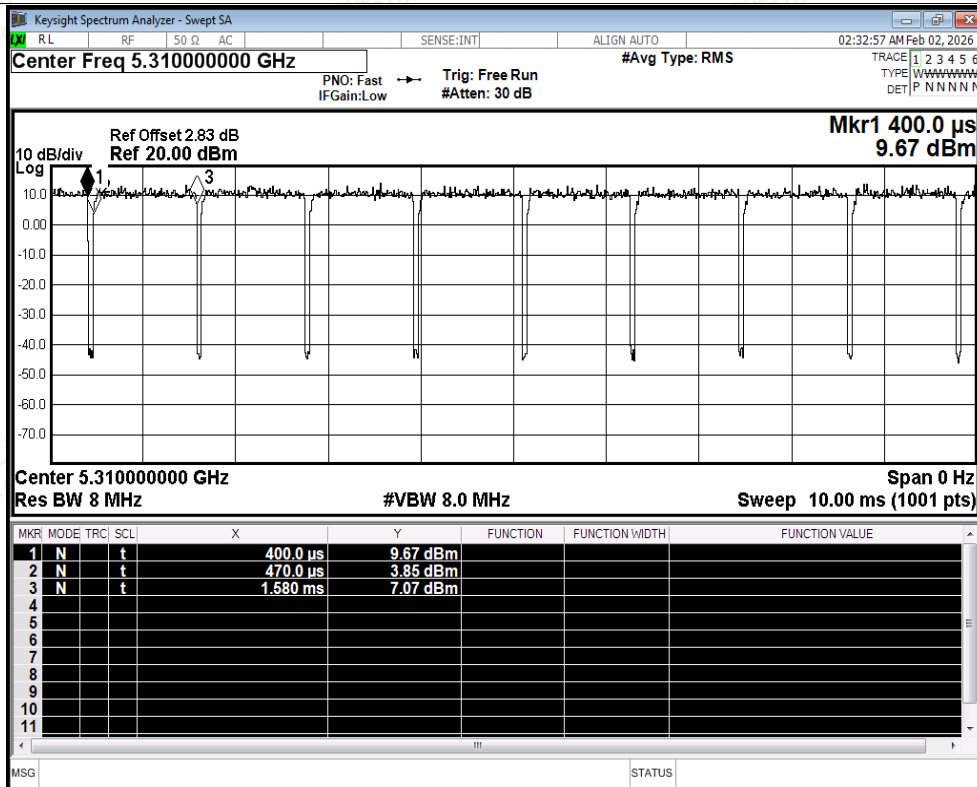


Duty Cycle NVNT n40 5310MHz Ant2



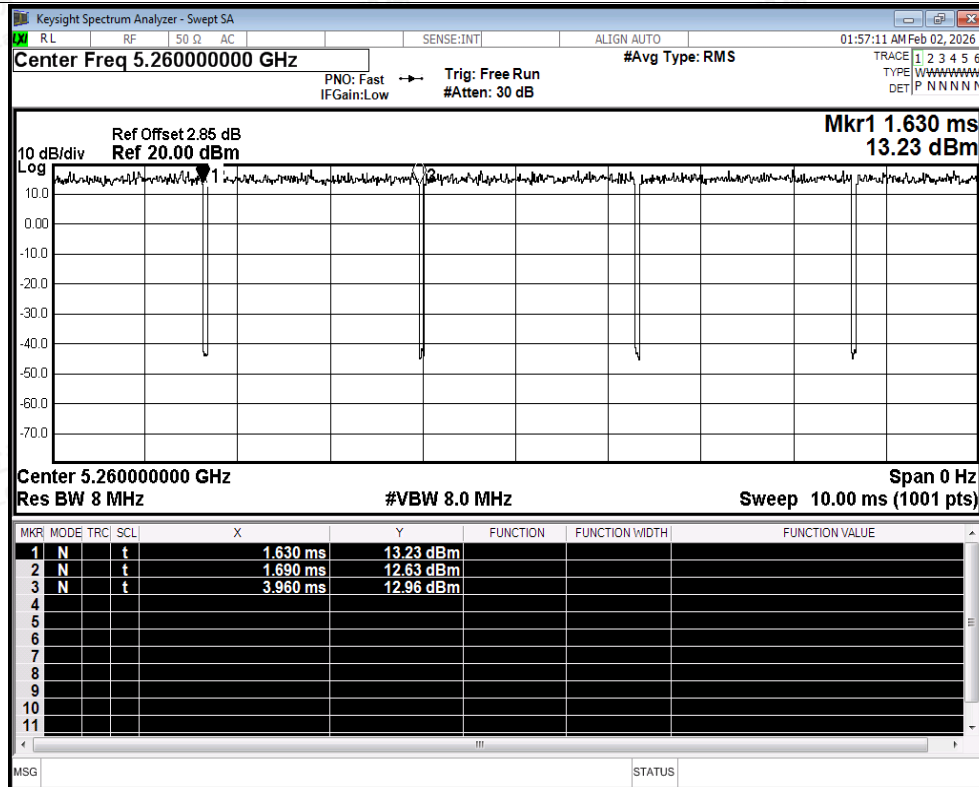

Duty Cycle NVNT ac20 5260MHz Ant2

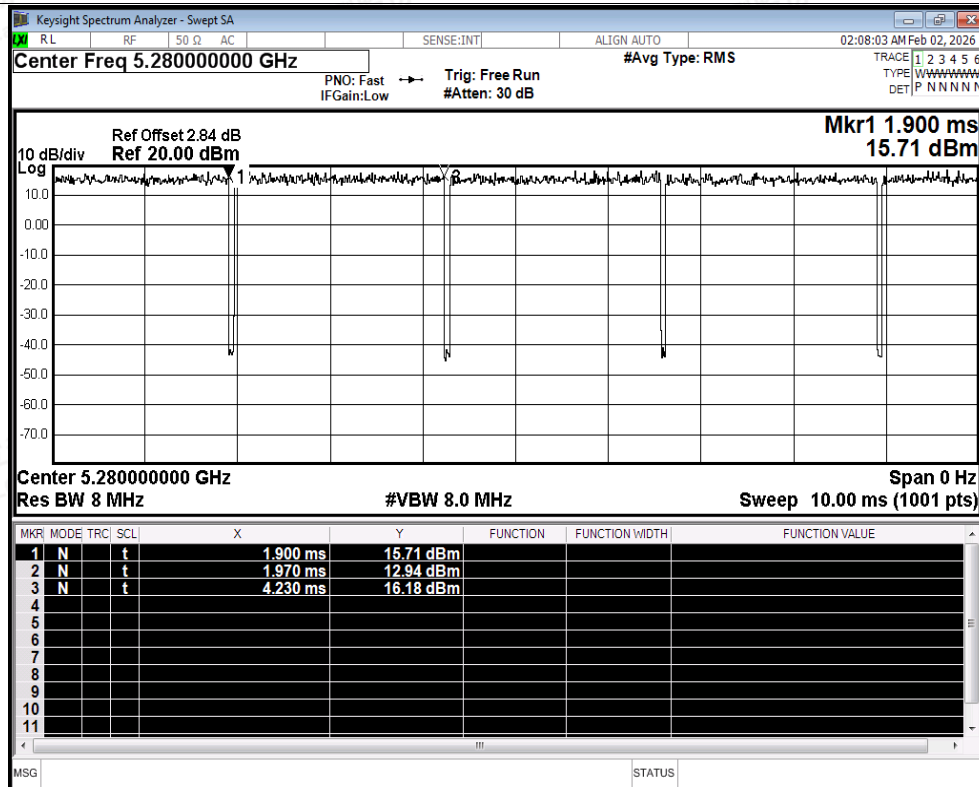

Duty Cycle NVNT ac20 5280MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

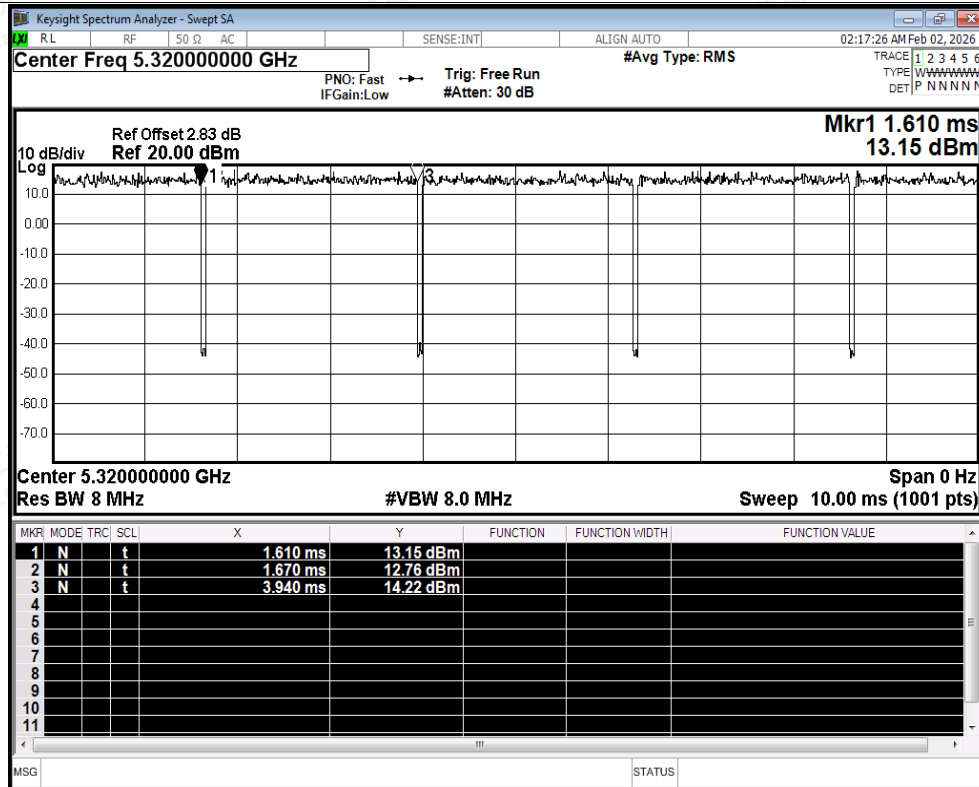

Duty Cycle NVNT ac20 5320MHz Ant2

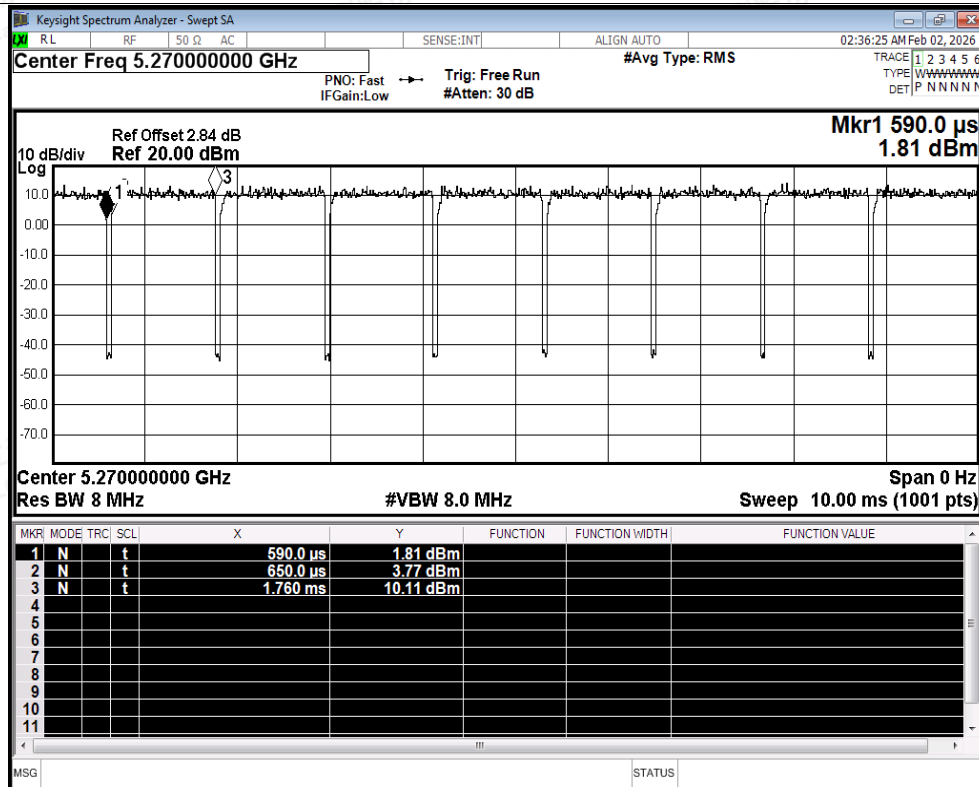

Duty Cycle NVNT ac40 5270MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

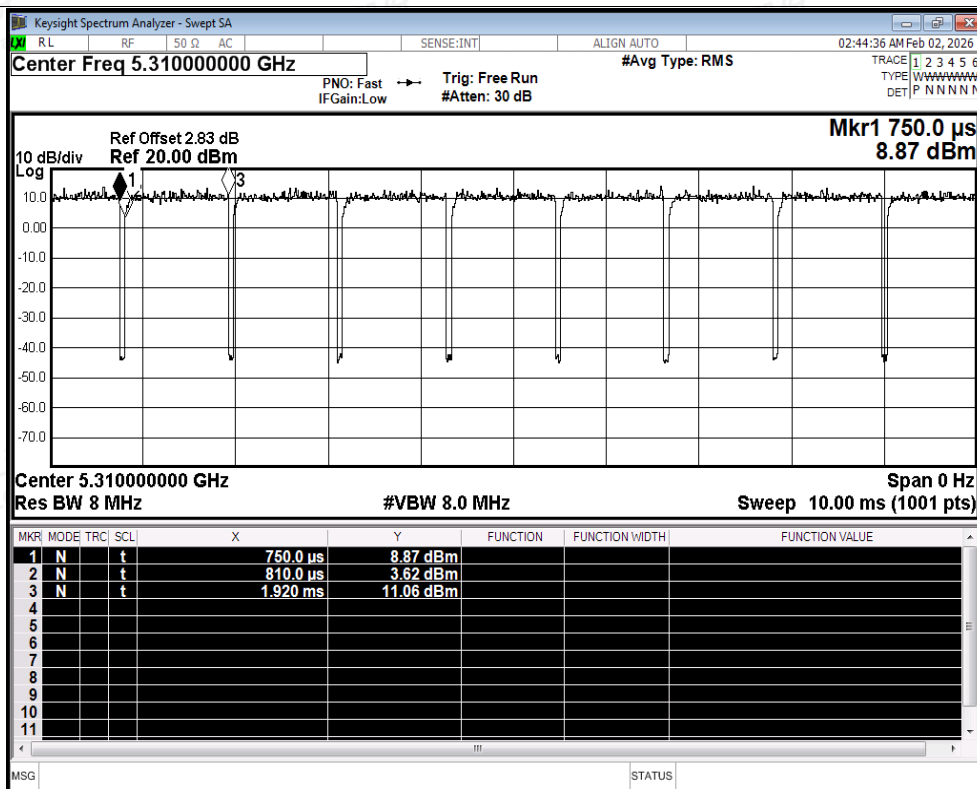

Duty Cycle NVNT ac40 5310MHz Ant2

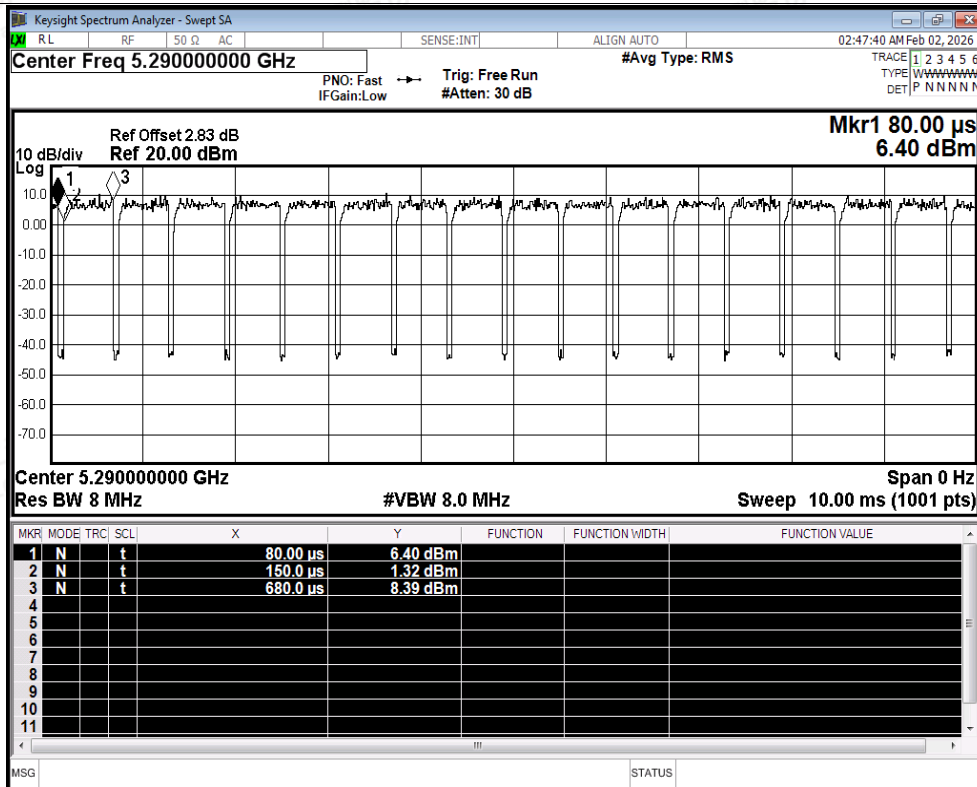

Duty Cycle NVNT ac80 5290MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

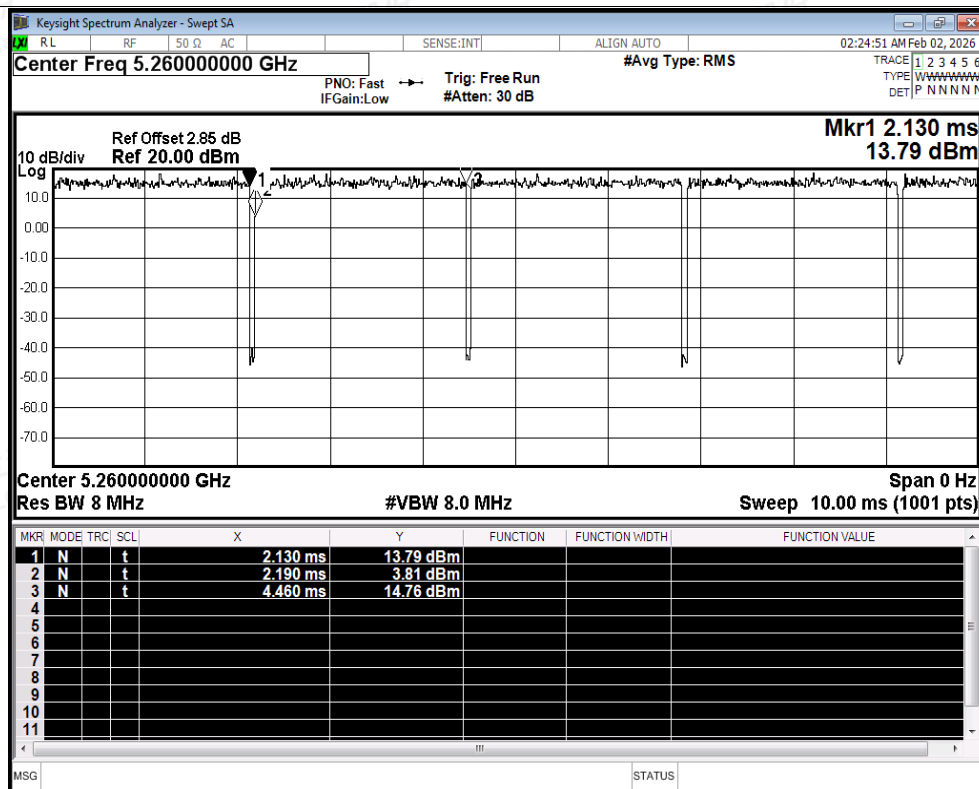

Duty Cycle NVNT ax20 5260MHz Ant2

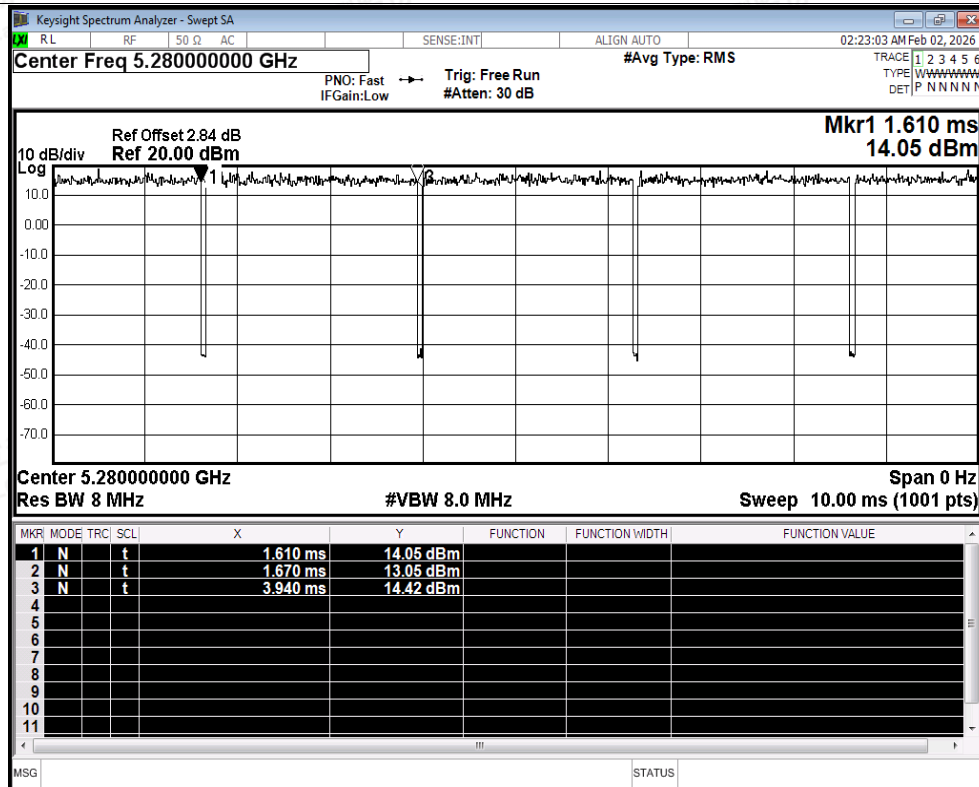

Duty Cycle NVNT ax20 5280MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

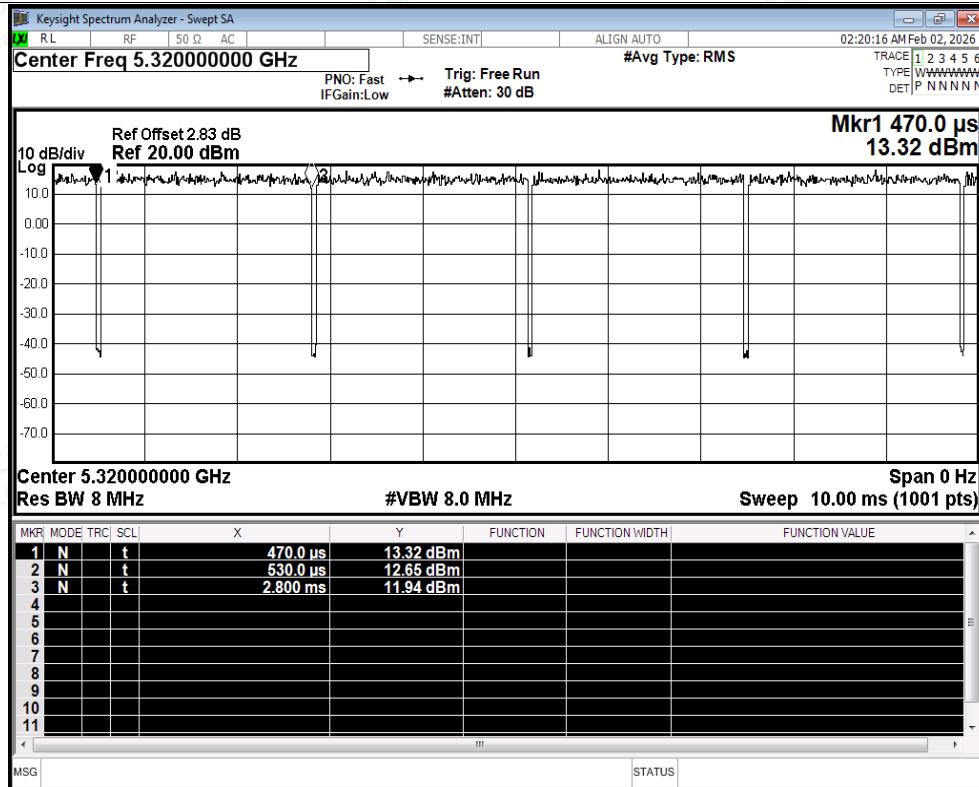

Duty Cycle NVNT ax20 5320MHz Ant2

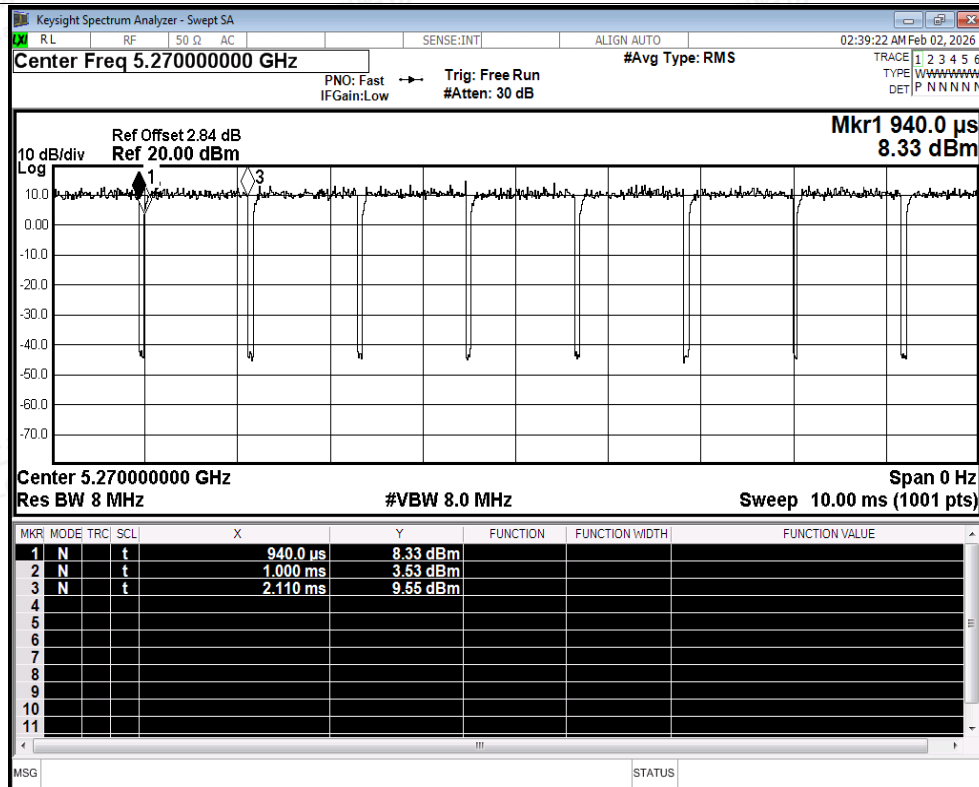

Duty Cycle NVNT ax40 5270MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

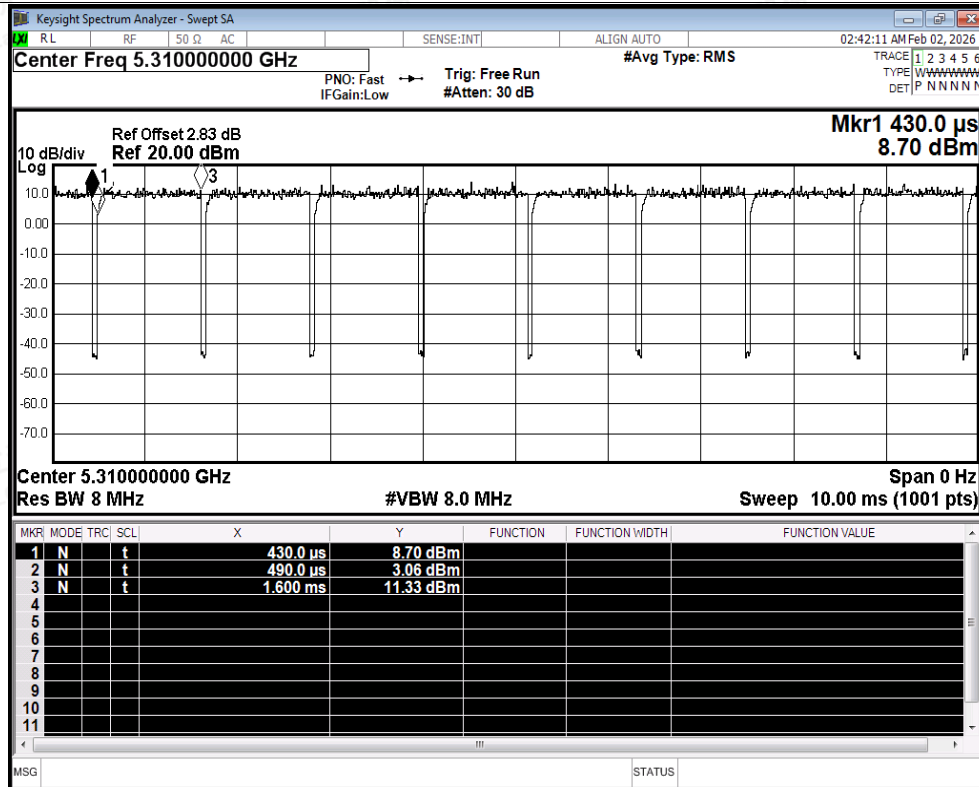

Duty Cycle NVNT ax40 5310MHz Ant2

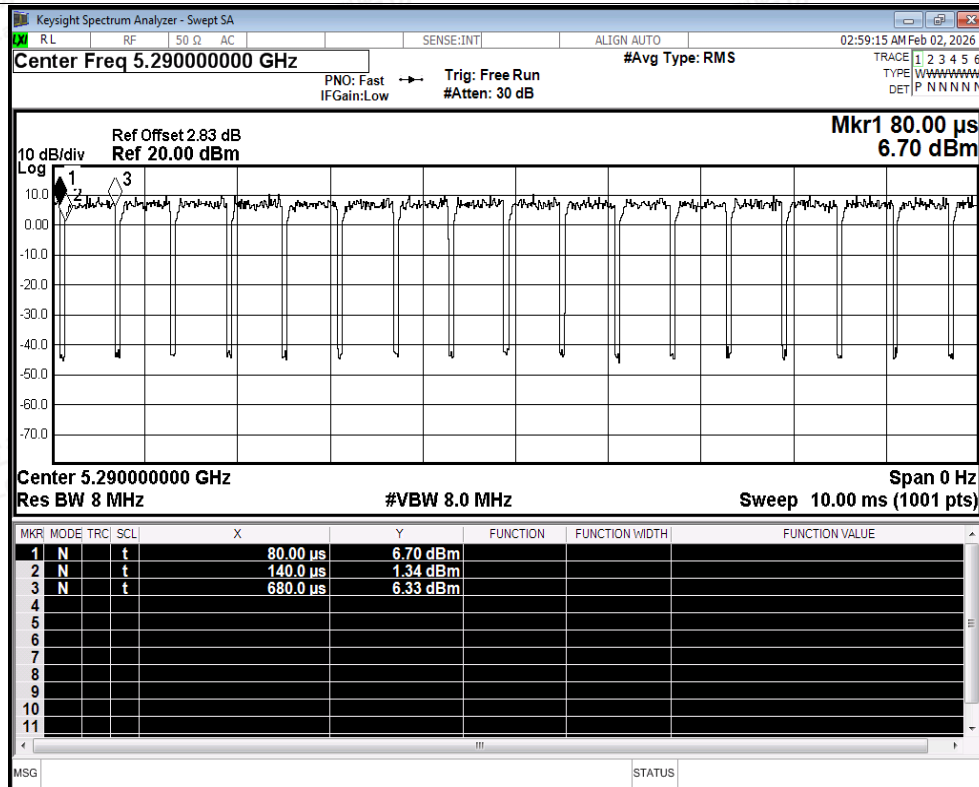

Duty Cycle NVNT ax80 5290MHz Ant2



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity