



F.4 Restrict Band

Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5500	Ant1	5460	-45.92	4.55	53.86	Peak	68.2	Pass
NVNT	a	5500	Ant1	5460	-54.52	4.55	45.26	Average	54	Pass
NVNT	a	5500	Ant1	5469.2	-36.73	4.55	63.05	Peak	68.2	Pass
NVNT	a	5500	Ant1	5470	-48.51	4.55	51.27	Average	54	Pass
NVNT	a	5500	Ant1	5470	-39.24	4.55	60.54	Peak	68.2	Pass
NVNT	a	5500	Ant1	5470	-48.51	4.55	51.27	Average	54	Pass
NVNT	a	5700	Ant1	5725	-40.88	4.55	58.90	Peak	68.2	Pass
NVNT	a	5700	Ant1	5725	-48.58	4.55	51.20	Average	54	Pass
NVNT	a	5700	Ant1	5726.2	-32.11	4.55	67.67	Peak	68.2	Pass
NVNT	a	5700	Ant1	5725	-48.58	4.55	51.20	Average	54	Pass
NVNT	a	5700	Ant1	5735	-49.92	4.55	49.86	Peak	68.2	Pass
NVNT	a	5700	Ant1	5735	-57.53	4.55	42.25	Average	54	Pass
NVNT	n20	5500	Ant1	5460	-48.24	4.55	51.54	Peak	68.2	Pass
NVNT	n20	5500	Ant1	5460	-56.41	4.55	43.37	Average	54	Pass
NVNT	n20	5500	Ant1	5467.8	-38.23	4.55	61.55	Peak	68.2	Pass
NVNT	n20	5500	Ant1	5470	-51.3	4.55	48.48	Average	54	Pass
NVNT	n20	5500	Ant1	5470	-42.44	4.55	57.34	Peak	68.2	Pass
NVNT	n20	5500	Ant1	5470	-51.3	4.55	48.48	Average	54	Pass
NVNT	n20	5700	Ant1	5725	-36.27	4.55	63.51	Peak	68.2	Pass
NVNT	n20	5700	Ant1	5725	-50.1	4.55	49.68	Average	54	Pass
NVNT	n20	5700	Ant1	5727.6	-34.71	4.55	65.07	Peak	68.2	Pass
NVNT	n20	5700	Ant1	5725.2	-49.91	4.55	49.87	Average	54	Pass
NVNT	n20	5700	Ant1	5735	-50.95	4.55	48.83	Peak	68.2	Pass
NVNT	n20	5700	Ant1	5735	-59.58	4.55	40.20	Average	54	Pass
NVNT	n40	5510	Ant1	5460	-51.17	4.55	48.61	Peak	68.2	Pass
NVNT	n40	5510	Ant1	5460	-59.88	4.55	39.90	Average	54	Pass
NVNT	n40	5510	Ant1	5467.2	-37.96	4.55	61.82	Peak	68.2	Pass
NVNT	n40	5510	Ant1	5470	-52.86	4.55	46.92	Average	54	Pass
NVNT	n40	5510	Ant1	5470	-41.4	4.55	58.38	Peak	68.2	Pass
NVNT	n40	5510	Ant1	5470	-52.86	4.55	46.92	Average	54	Pass
NVNT	n40	5670	Ant1	5725	-49.74	4.55	50.04	Peak	68.2	Pass
NVNT	n40	5670	Ant1	5725	-57.05	4.55	42.73	Average	54	Pass
NVNT	n40	5670	Ant1	5729.2	-48.2	4.55	51.58	Peak	68.2	Pass
NVNT	n40	5670	Ant1	5725.6	-57.02	4.55	42.76	Average	54	Pass
NVNT	n40	5670	Ant1	5735	-50.2	4.55	49.58	Peak	68.2	Pass
NVNT	n40	5670	Ant1	5735	-57.16	4.55	42.62	Average	54	Pass
NVNT	ac20	5500	Ant1	5460	-52.67	4.55	47.11	Peak	68.2	Pass
NVNT	ac20	5500	Ant1	5460	-60.96	4.55	38.82	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5500	Ant1	5469.4	-40.61	4.55	59.17	Peak	68.2	Pass
NVNT	ac20	5500	Ant1	5470	-53.25	4.55	46.53	Average	54	Pass
NVNT	ac20	5500	Ant1	5470	-44.06	4.55	55.72	Peak	68.2	Pass
NVNT	ac20	5500	Ant1	5470	-53.25	4.55	46.53	Average	54	Pass
NVNT	ac20	5700	Ant1	5725	-36.44	4.55	63.34	Peak	68.2	Pass
NVNT	ac20	5700	Ant1	5725	-49.59	4.55	50.19	Average	54	Pass
NVNT	ac20	5700	Ant1	5725.2	-35.95	4.55	63.83	Peak	68.2	Pass
NVNT	ac20	5700	Ant1	5725	-49.59	4.55	50.19	Average	54	Pass
NVNT	ac20	5700	Ant1	5735	-48.16	4.55	51.62	Peak	68.2	Pass
NVNT	ac20	5700	Ant1	5735	-59.58	4.55	40.20	Average	54	Pass
NVNT	ac40	5510	Ant1	5460	-47.13	4.55	52.65	Peak	68.2	Pass
NVNT	ac40	5510	Ant1	5460	-55.48	4.55	44.30	Average	54	Pass
NVNT	ac40	5510	Ant1	5469	-39.25	4.55	60.53	Peak	68.2	Pass
NVNT	ac40	5510	Ant1	5470	-51.13	4.55	48.65	Average	54	Pass
NVNT	ac40	5510	Ant1	5470	-44.13	4.55	55.65	Peak	68.2	Pass
NVNT	ac40	5510	Ant1	5470	-51.13	4.55	48.65	Average	54	Pass
NVNT	ac40	5670	Ant1	5725	-48.95	4.55	50.83	Peak	68.2	Pass
NVNT	ac40	5670	Ant1	5725	-57.05	4.55	42.73	Average	54	Pass
NVNT	ac40	5670	Ant1	5726.8	-48.21	4.55	51.57	Peak	68.2	Pass
NVNT	ac40	5670	Ant1	5725.6	-56.85	4.55	42.93	Average	54	Pass
NVNT	ac40	5670	Ant1	5735	-49.72	4.55	50.06	Peak	68.2	Pass
NVNT	ac40	5670	Ant1	5735	-57.24	4.55	42.54	Average	54	Pass
NVNT	ac80	5530	Ant1	5460	-43	4.55	56.78	Peak	68.2	Pass
NVNT	ac80	5530	Ant1	5460	-51.96	4.55	47.82	Average	54	Pass
NVNT	ac80	5530	Ant1	5467.4	-39.62	4.55	60.16	Peak	68.2	Pass
NVNT	ac80	5530	Ant1	5463.2	-51.52	4.55	48.26	Average	54	Pass
NVNT	ac80	5530	Ant1	5470	-44.72	4.55	55.06	Peak	68.2	Pass
NVNT	ac80	5530	Ant1	5470	-51.78	4.55	48.00	Average	54	Pass
NVNT	ac80	5610	Ant1	5725	-50.23	4.55	49.55	Peak	68.2	Pass
NVNT	ac80	5610	Ant1	5725	-56.81	4.55	42.97	Average	54	Pass
NVNT	ac80	5610	Ant1	5728.44	-48.02	4.55	51.76	Peak	68.2	Pass
NVNT	ac80	5610	Ant1	5733.77	-56.36	4.55	43.42	Average	54	Pass
NVNT	ac80	5610	Ant1	5735	-49.66	4.55	50.12	Peak	68.2	Pass
NVNT	ac80	5610	Ant1	5735	-56.88	4.55	42.90	Average	54	Pass
NVNT	ax20	5500	Ant1	5460	-42.66	4.55	57.12	Peak	68.2	Pass
NVNT	ax20	5500	Ant1	5460	-52.65	4.55	47.13	Average	54	Pass
NVNT	ax20	5500	Ant1	5469.4	-36.12	4.55	63.66	Peak	68.2	Pass
NVNT	ax20	5500	Ant1	5470	-46.02	4.55	53.76	Average	54	Pass
NVNT	ax20	5500	Ant1	5470	-38.01	4.55	61.77	Peak	68.2	Pass
NVNT	ax20	5500	Ant1	5470	-46.02	4.55	53.76	Average	54	Pass
NVNT	ax20	5700	Ant1	5725	-36.99	4.55	62.79	Peak	68.2	Pass
NVNT	ax20	5700	Ant1	5725	-49.7	4.55	50.08	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax20	5700	Ant1	5727	-33.78	4.55	66.00	Peak	68.2	Pass
NVNT	ax20	5700	Ant1	5725	-49.7	4.55	50.08	Average	54	Pass
NVNT	ax20	5700	Ant1	5735	-48.1	4.55	51.68	Peak	68.2	Pass
NVNT	ax20	5700	Ant1	5735	-59.43	4.55	40.35	Average	54	Pass
NVNT	ax40	5510	Ant1	5460	-48.19	4.55	51.59	Peak	68.2	Pass
NVNT	ax40	5510	Ant1	5460	-55.06	4.55	44.72	Average	54	Pass
NVNT	ax40	5510	Ant1	5468.8	-41.7	4.55	58.08	Peak	68.2	Pass
NVNT	ax40	5510	Ant1	5469.8	-50.49	4.55	49.29	Average	54	Pass
NVNT	ax40	5510	Ant1	5470	-42.32	4.55	57.46	Peak	68.2	Pass
NVNT	ax40	5510	Ant1	5470	-50.93	4.55	48.85	Average	54	Pass
NVNT	ax40	5670	Ant1	5725	-50.64	4.55	49.14	Peak	68.2	Pass
NVNT	ax40	5670	Ant1	5725	-57.1	4.55	42.68	Average	54	Pass
NVNT	ax40	5670	Ant1	5726.6	-46.98	4.55	52.80	Peak	68.2	Pass
NVNT	ax40	5670	Ant1	5731	-56.97	4.55	42.81	Average	54	Pass
NVNT	ax40	5670	Ant1	5735	-50.37	4.55	49.41	Peak	68.2	Pass
NVNT	ax40	5670	Ant1	5735	-57.2	4.55	42.58	Average	54	Pass
NVNT	ax80	5530	Ant1	5460	-46.11	4.55	53.67	Peak	68.2	Pass
NVNT	ax80	5530	Ant1	5460	-53.94	4.55	45.84	Average	54	Pass
NVNT	ax80	5530	Ant1	5467.8	-42.17	4.55	57.61	Peak	68.2	Pass
NVNT	ax80	5530	Ant1	5464.8	-53.69	4.55	46.09	Average	54	Pass
NVNT	ax80	5530	Ant1	5470	-45.46	4.55	54.32	Peak	68.2	Pass
NVNT	ax80	5530	Ant1	5470	-53.97	4.55	45.81	Average	54	Pass
NVNT	ax80	5610	Ant1	5725	-57.15	4.55	42.63	Peak	68.2	Pass
NVNT	ax80	5610	Ant1	5725	-63.15	4.55	36.63	Average	54	Pass
NVNT	ax80	5610	Ant1	5726.8	-55.29	4.55	44.49	Peak	68.2	Pass
NVNT	ax80	5610	Ant1	5725.16	-63.15	4.55	36.63	Average	54	Pass
NVNT	ax80	5610	Ant1	5735	-55.49	4.55	44.29	Peak	68.2	Pass
NVNT	ax80	5610	Ant1	5735	-63.69	4.55	36.09	Average	54	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

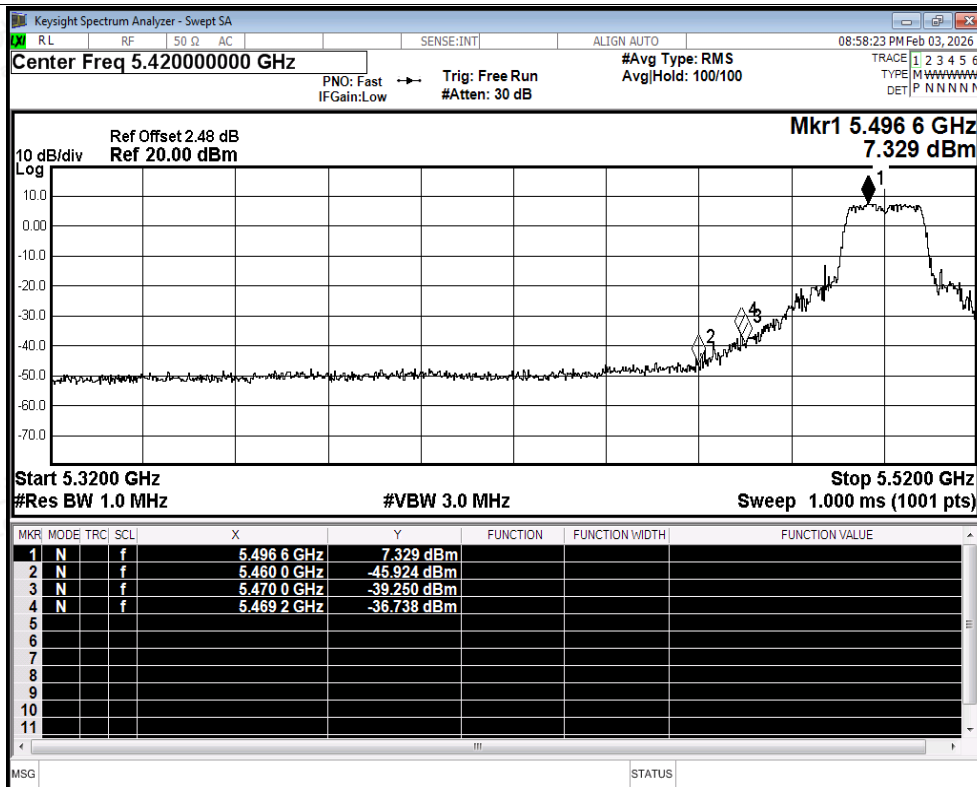

Restrict Band NVNT a 5500MHz Ant1 Peak

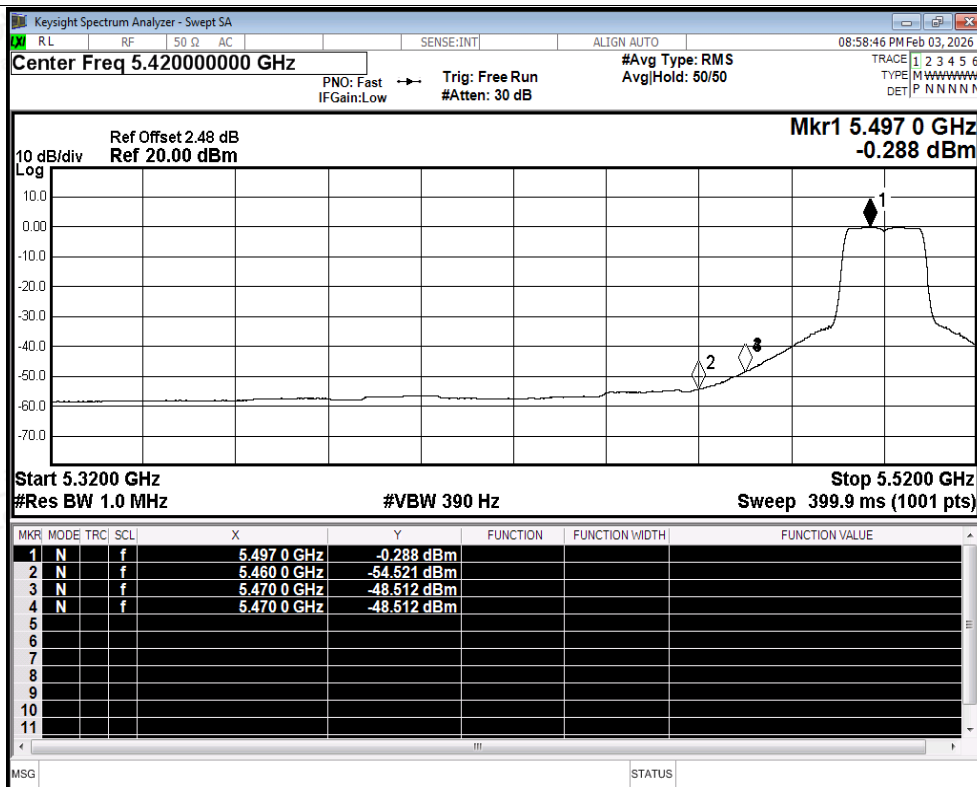

Restrict Band NVNT a 5500MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

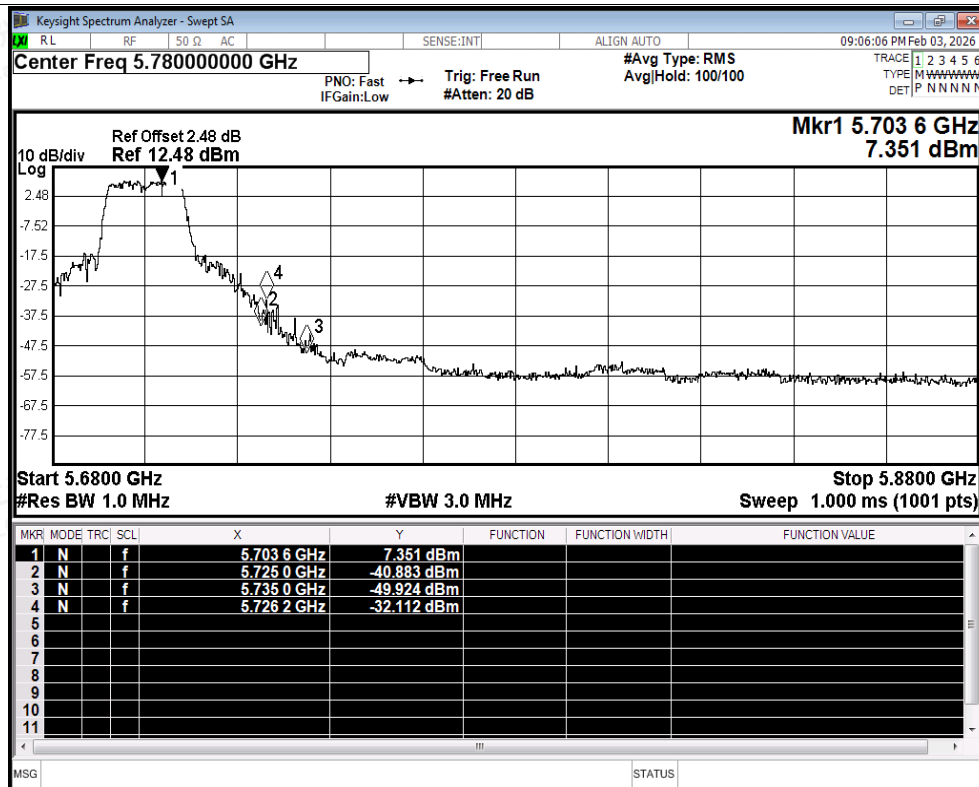

Restrict Band NVNT a 5700MHz Ant1 Peak

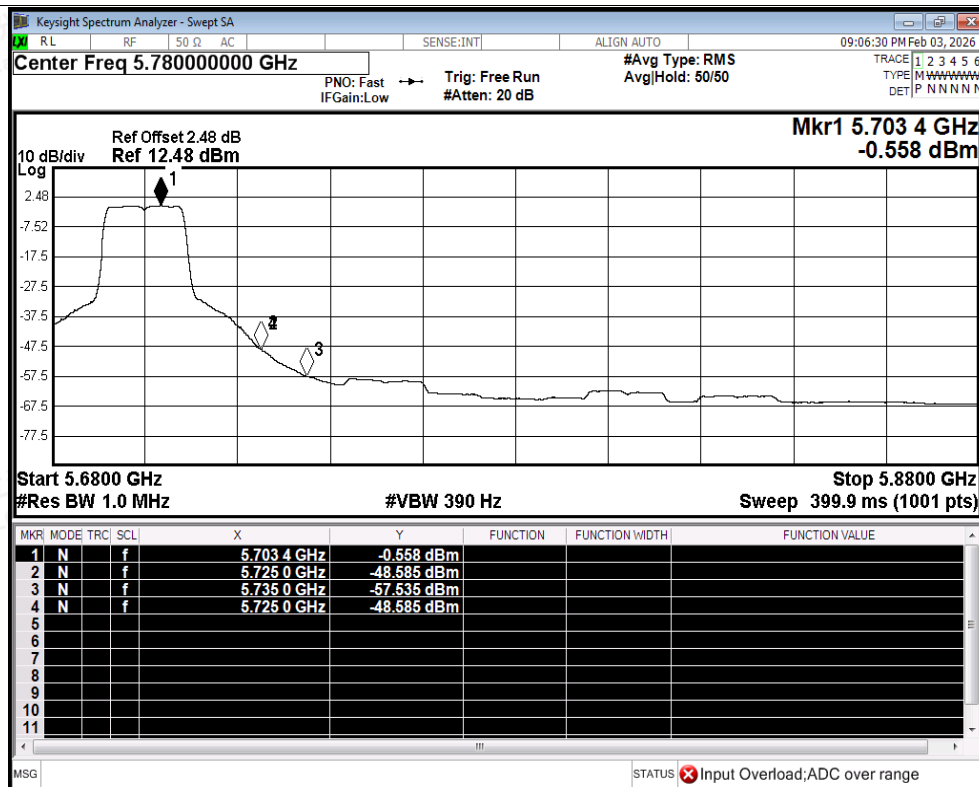

Restrict Band NVNT a 5700MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

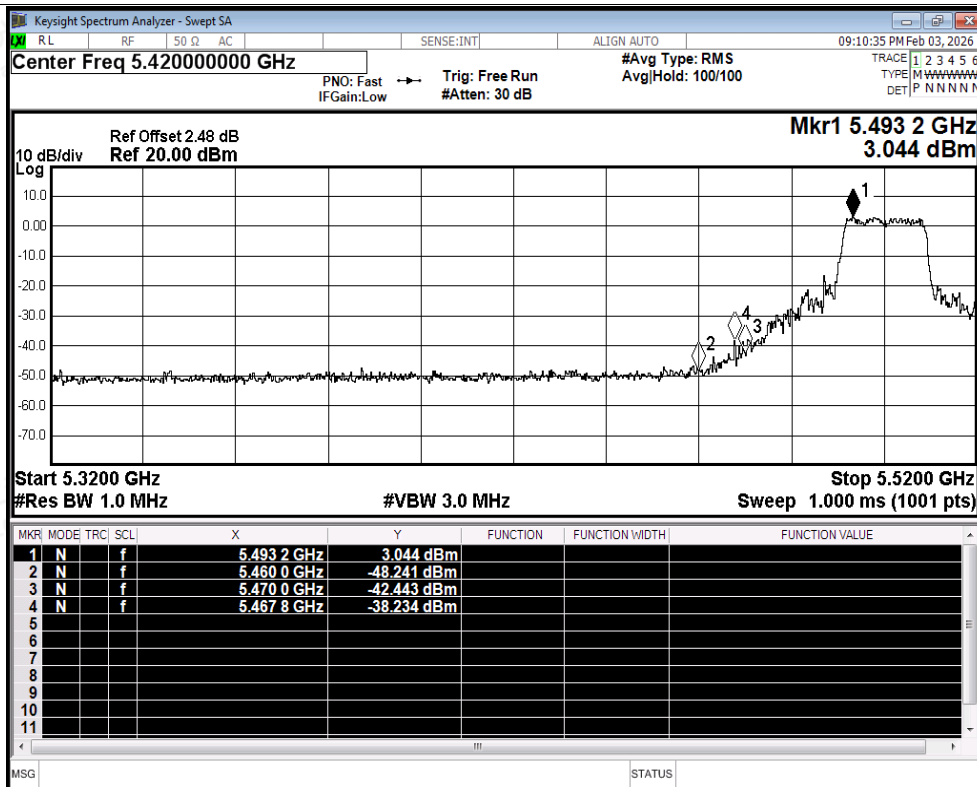

Restrict Band NVNT n20 5500MHz Ant1 Peak

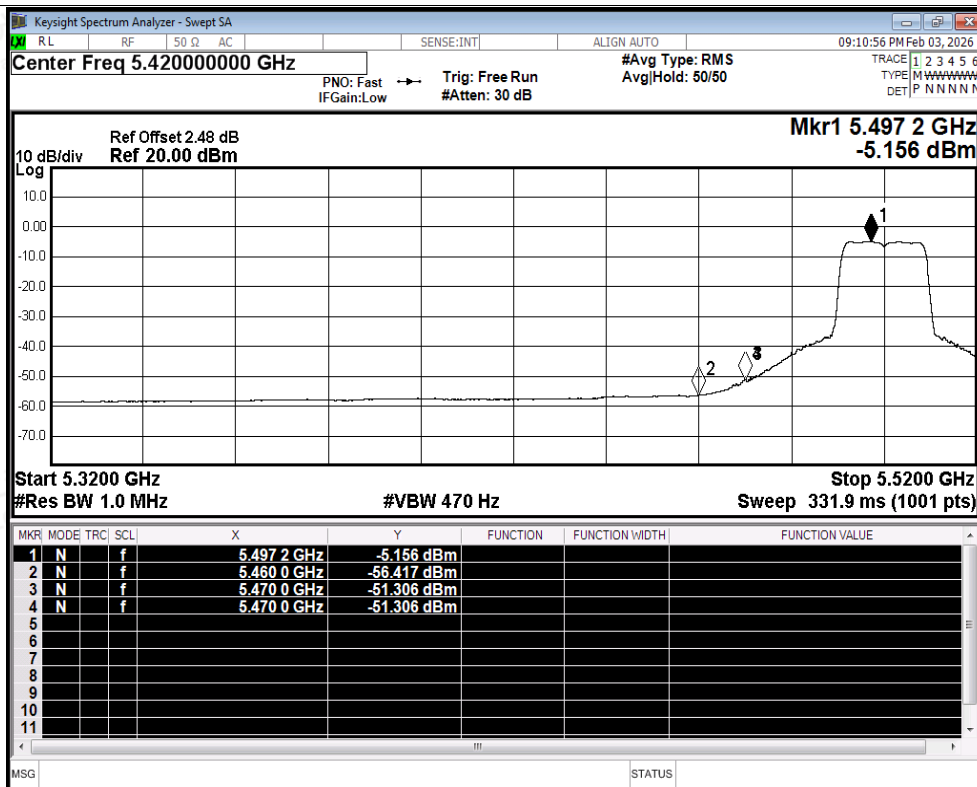

Restrict Band NVNT n20 5500MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

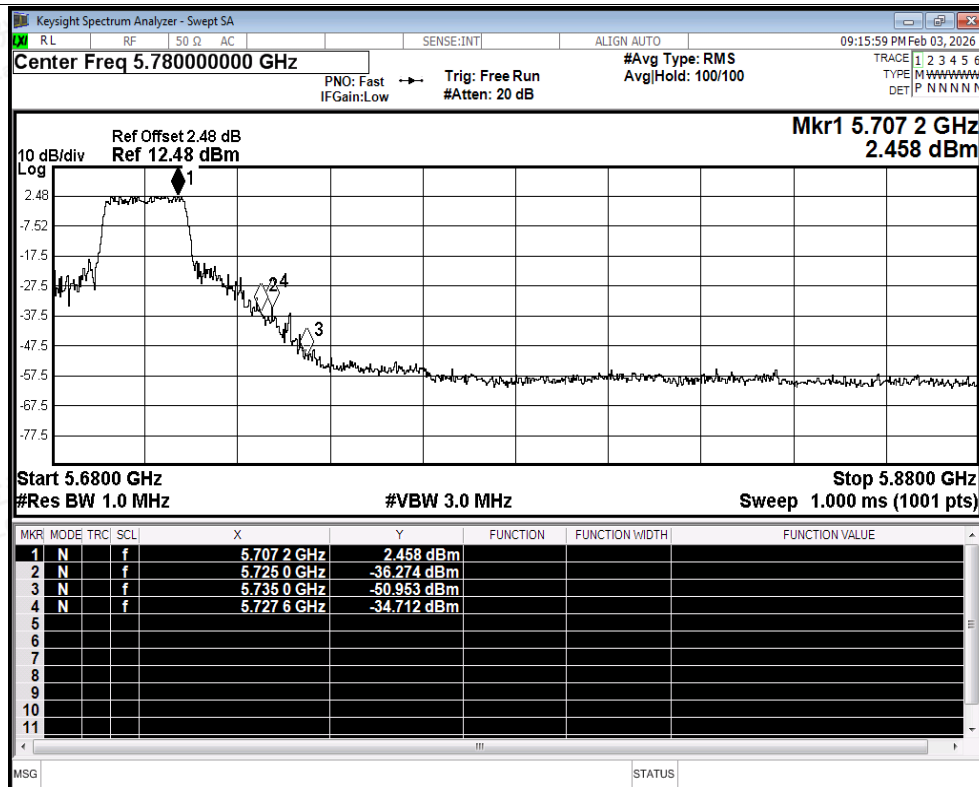

Restrict Band NVNT n20 5700MHz Ant1 Peak

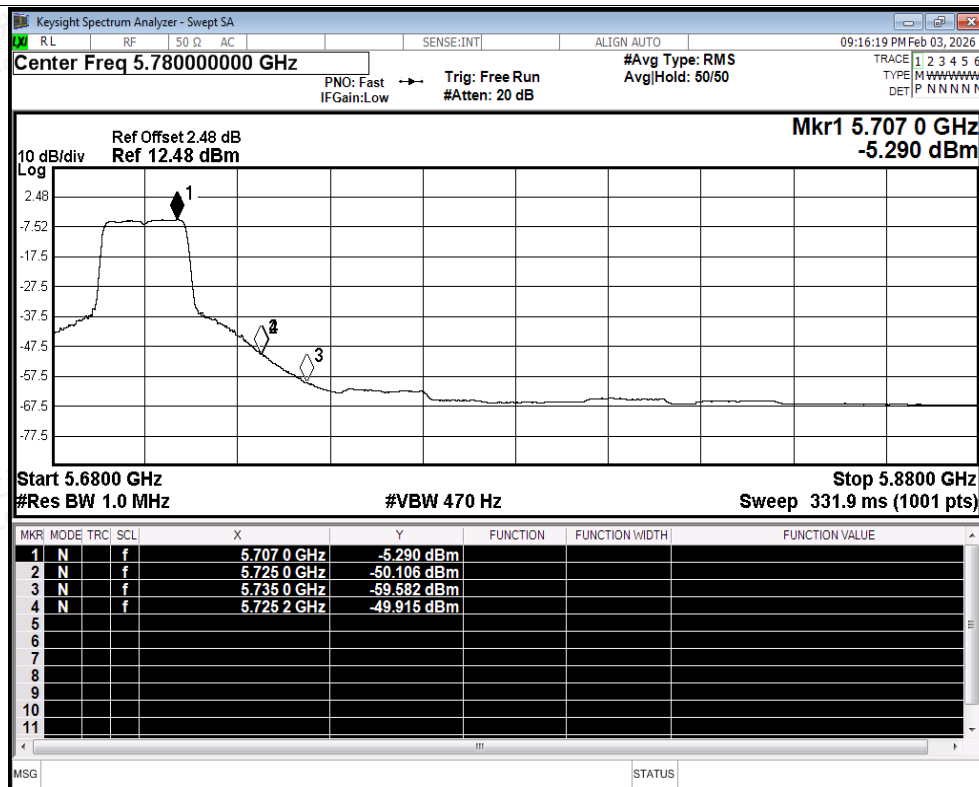

Restrict Band NVNT n20 5700MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

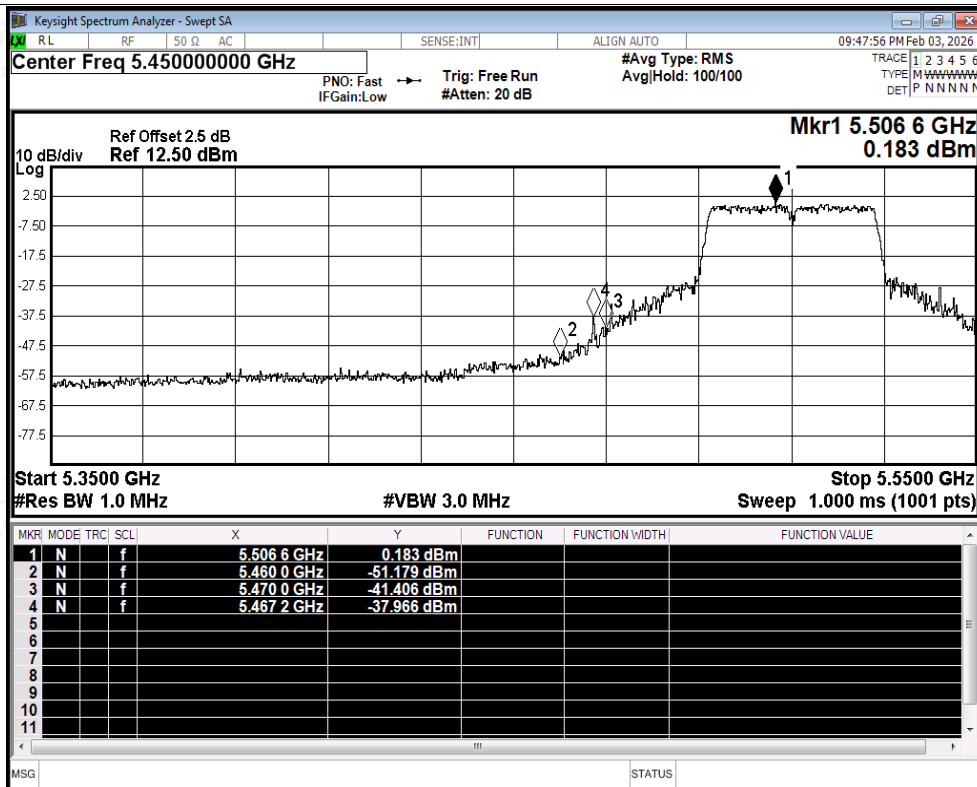

Restrict Band NVNT n40 5510MHz Ant1 Peak

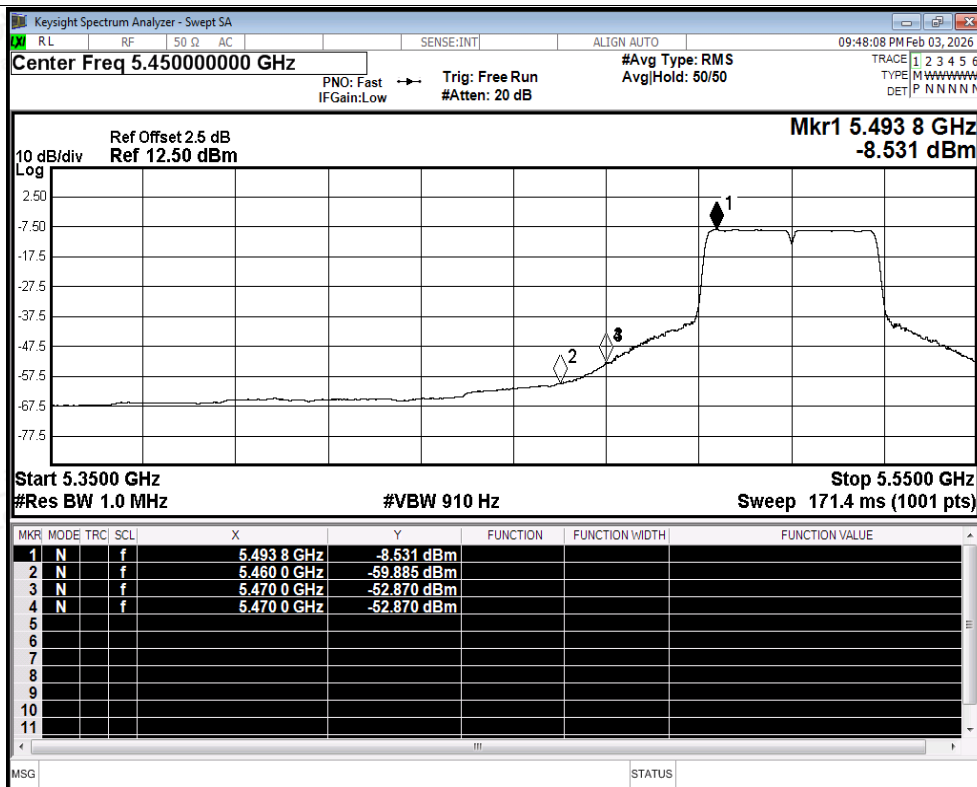

Restrict Band NVNT n40 5510MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

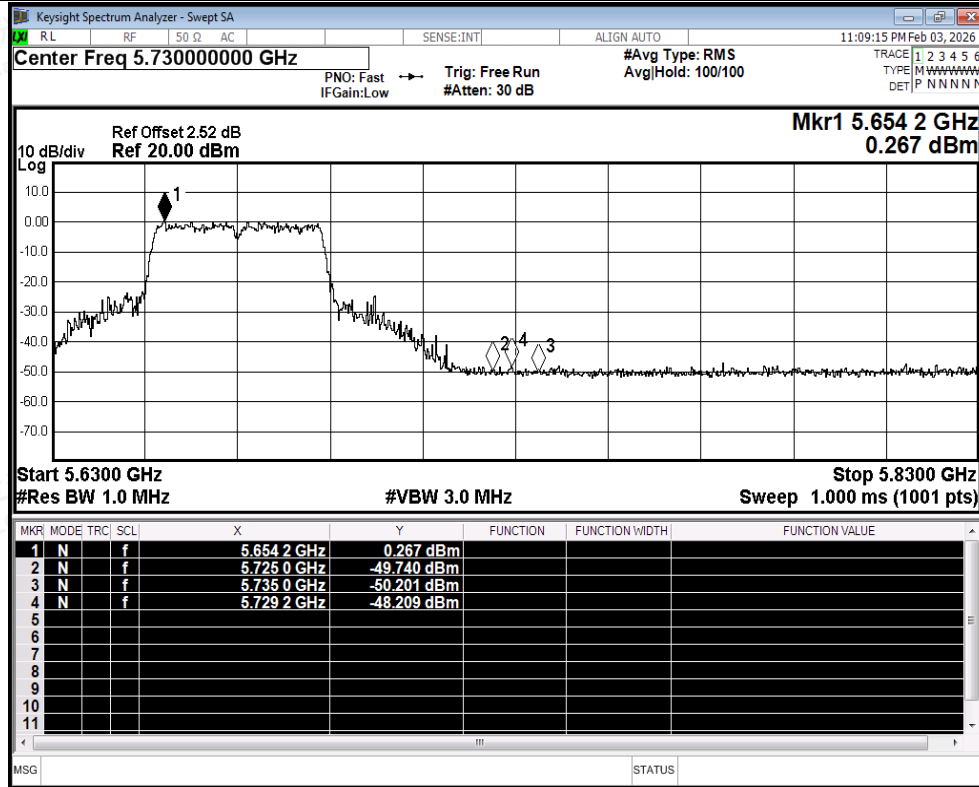

Restrict Band NVNT n40 5670MHz Ant1 Peak

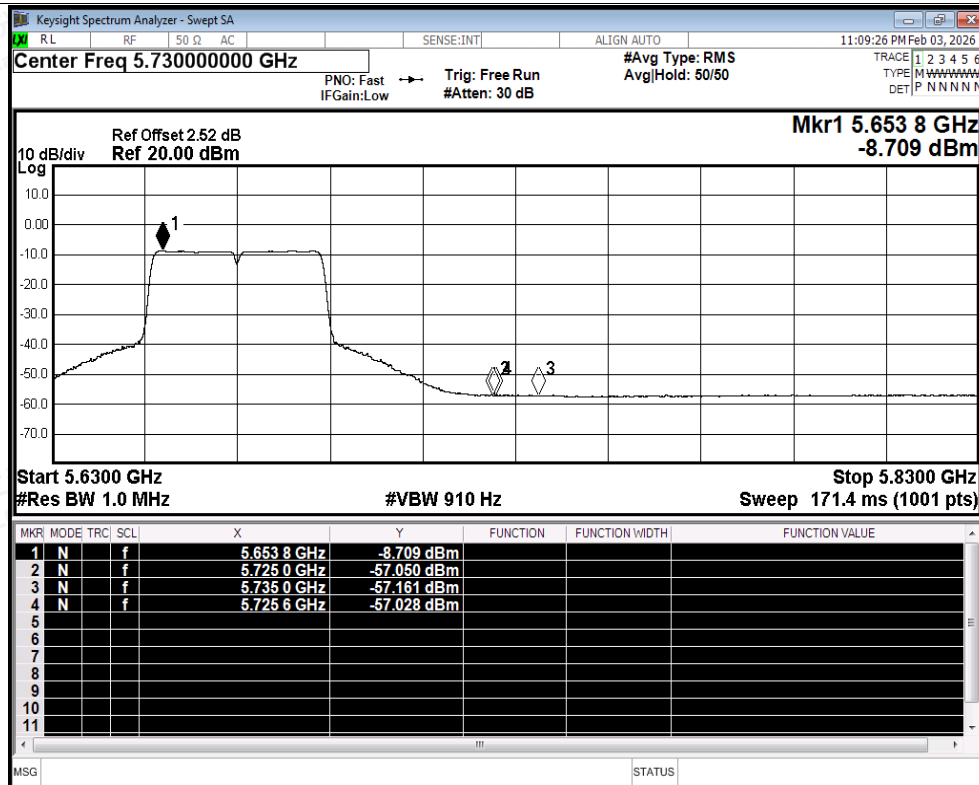

Restrict Band NVNT n40 5670MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

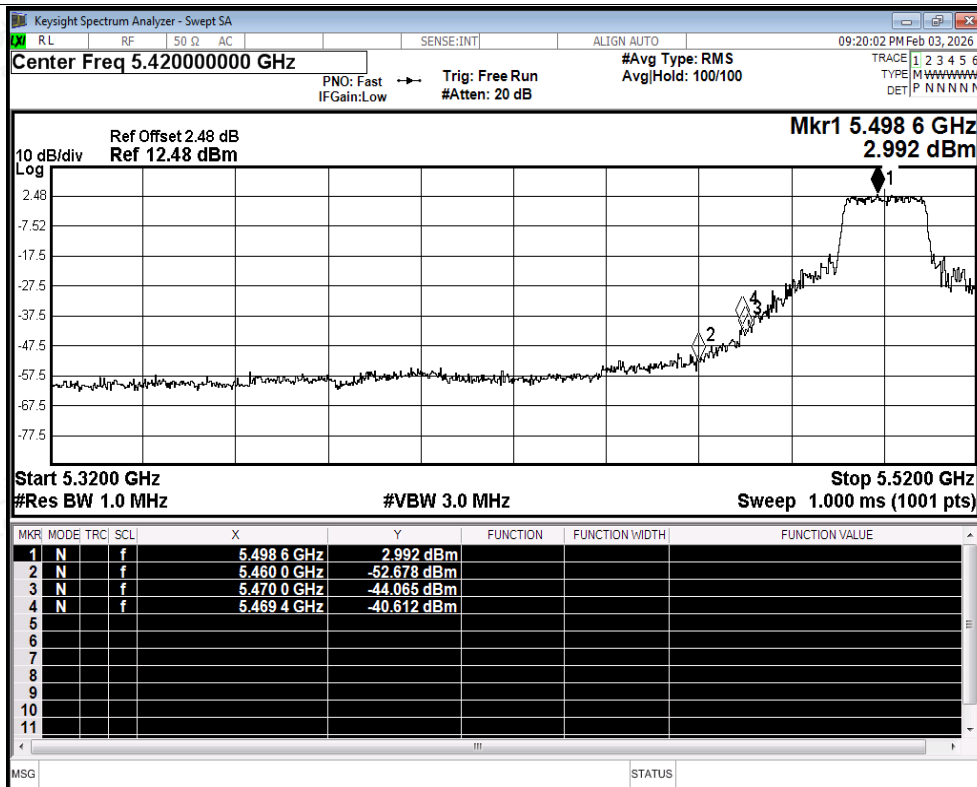

Restrict Band NVNT ac20 5500MHz Ant1 Peak

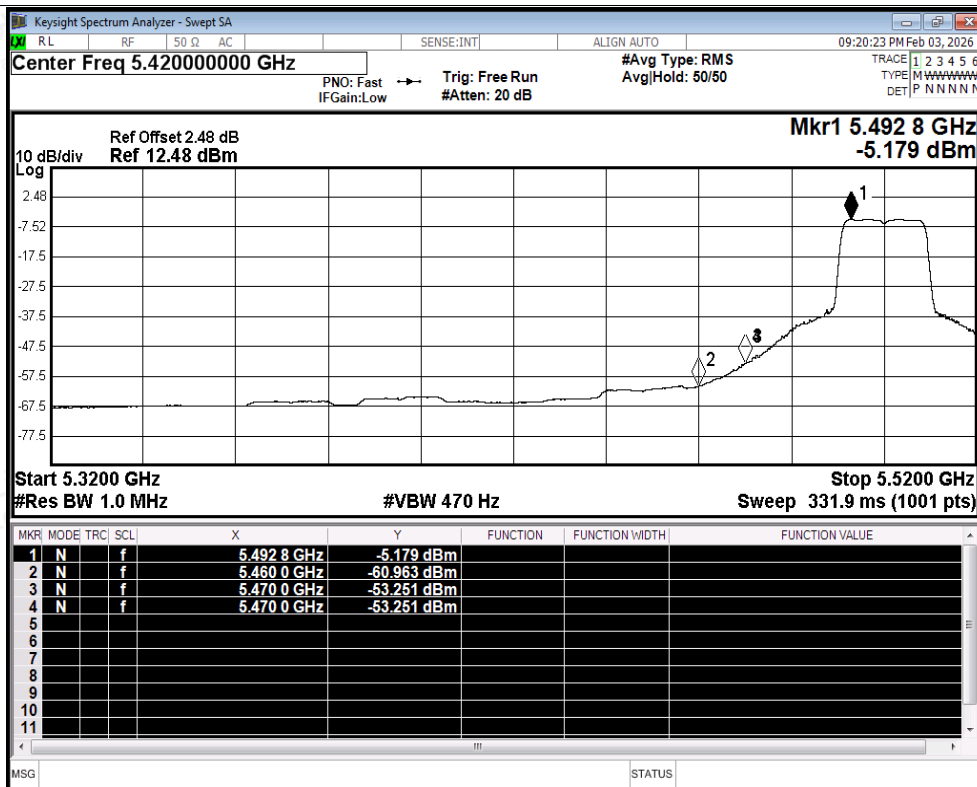

Restrict Band NVNT ac20 5500MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

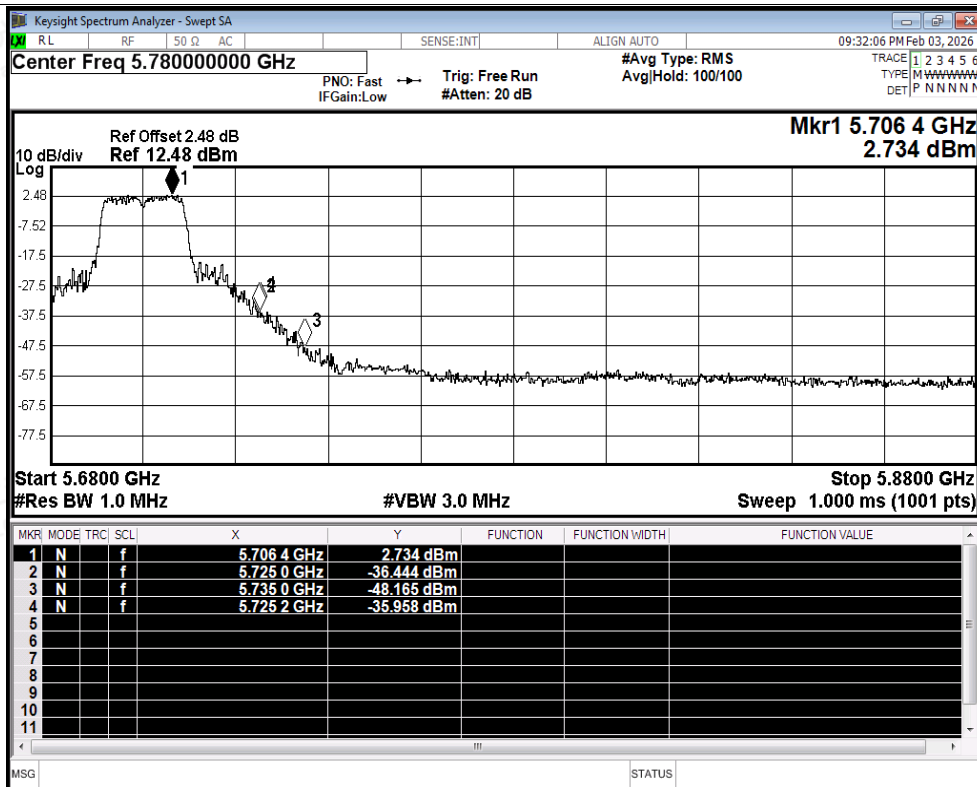

Restrict Band NVNT ac20 5700MHz Ant1 Peak

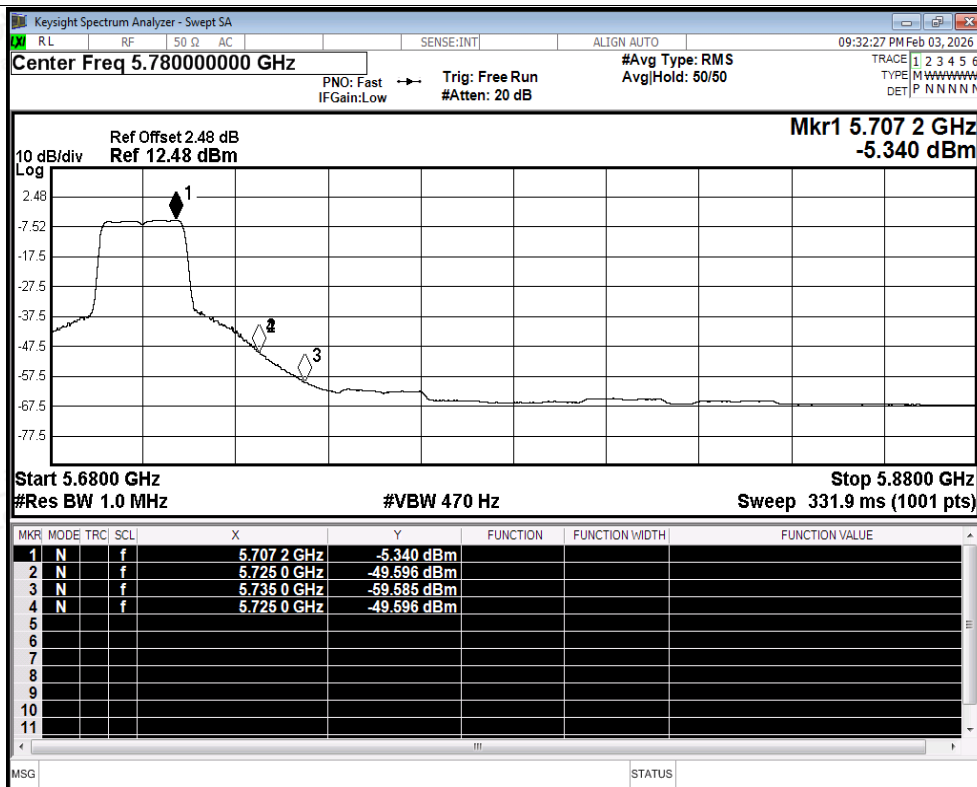

Restrict Band NVNT ac20 5700MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

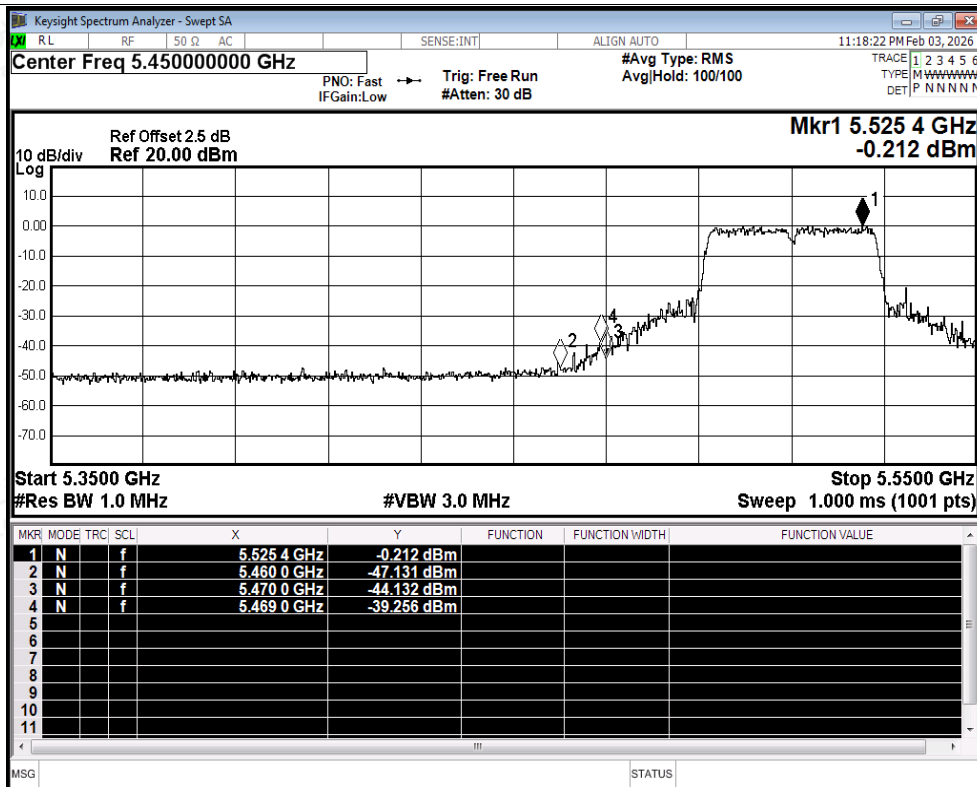

Restrict Band NVNT ac40 5510MHz Ant1 Peak

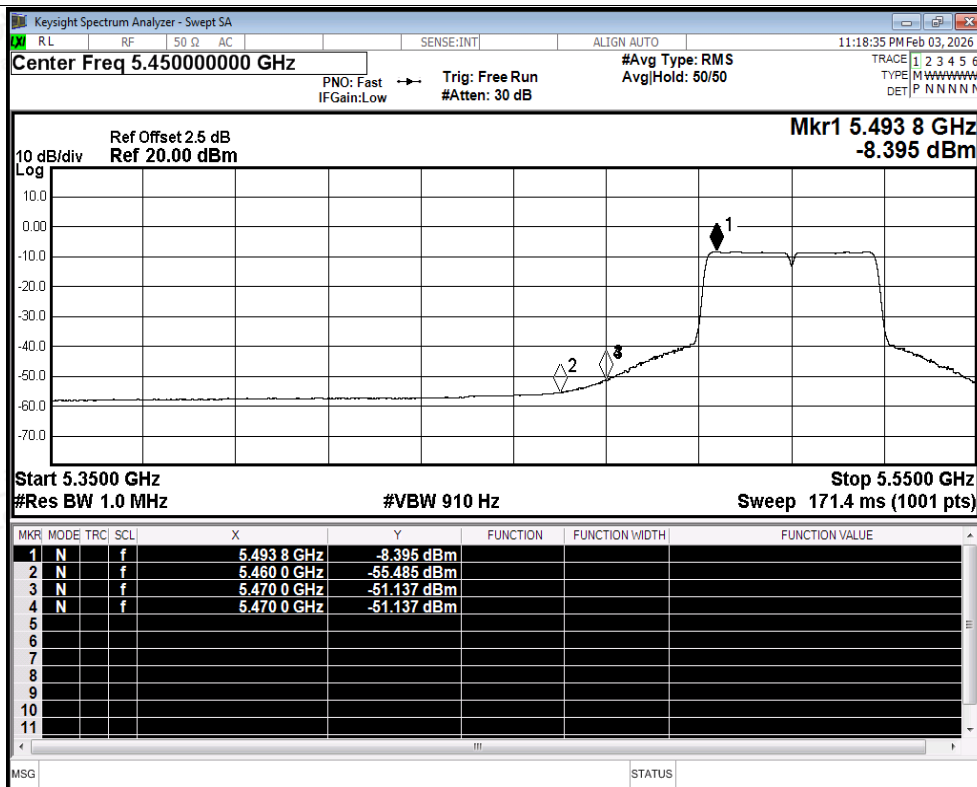

Restrict Band NVNT ac40 5510MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

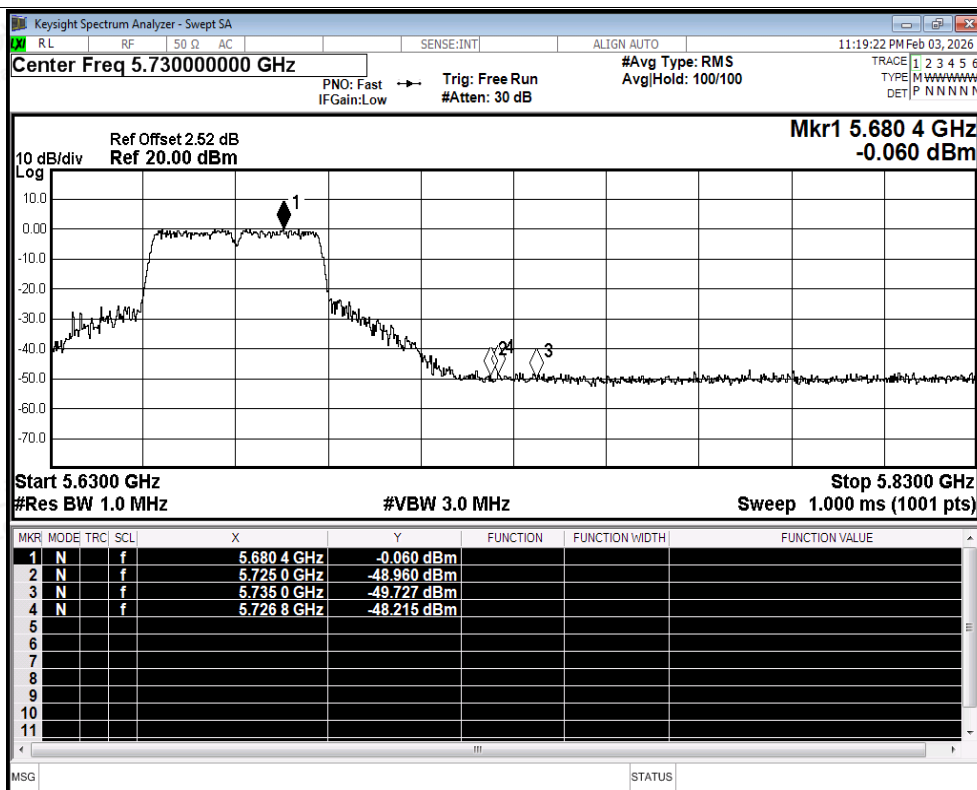

Restrict Band NVNT ac40 5670MHz Ant1 Peak

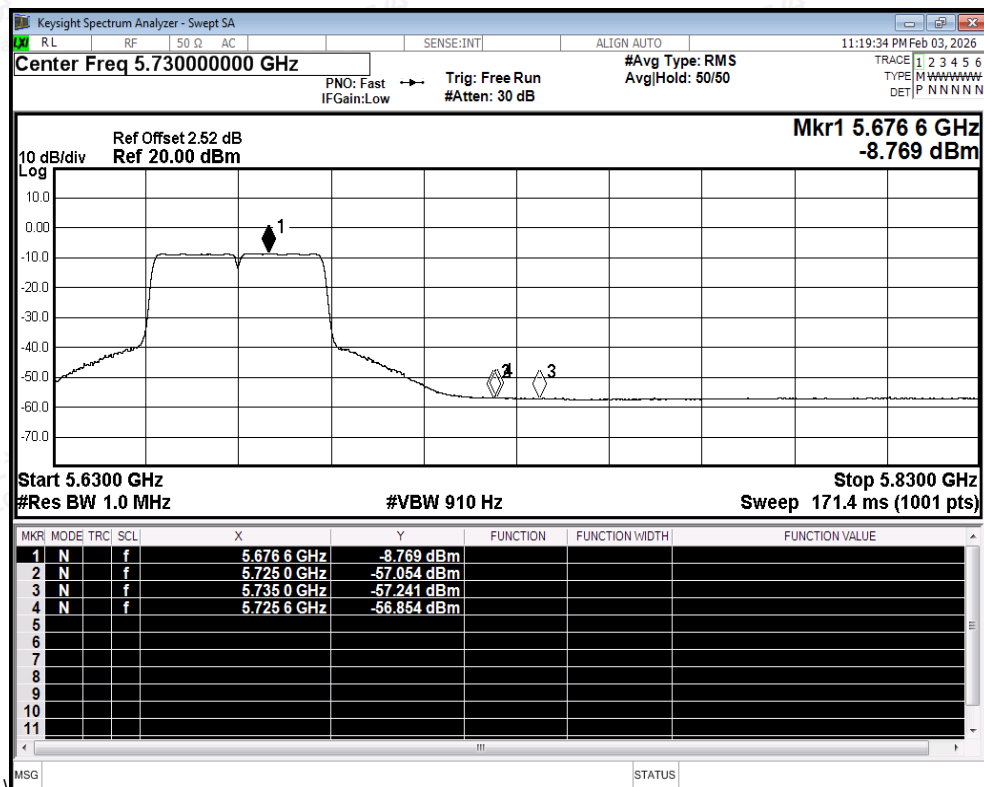

Restrict Band NVNT ac40 5670MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

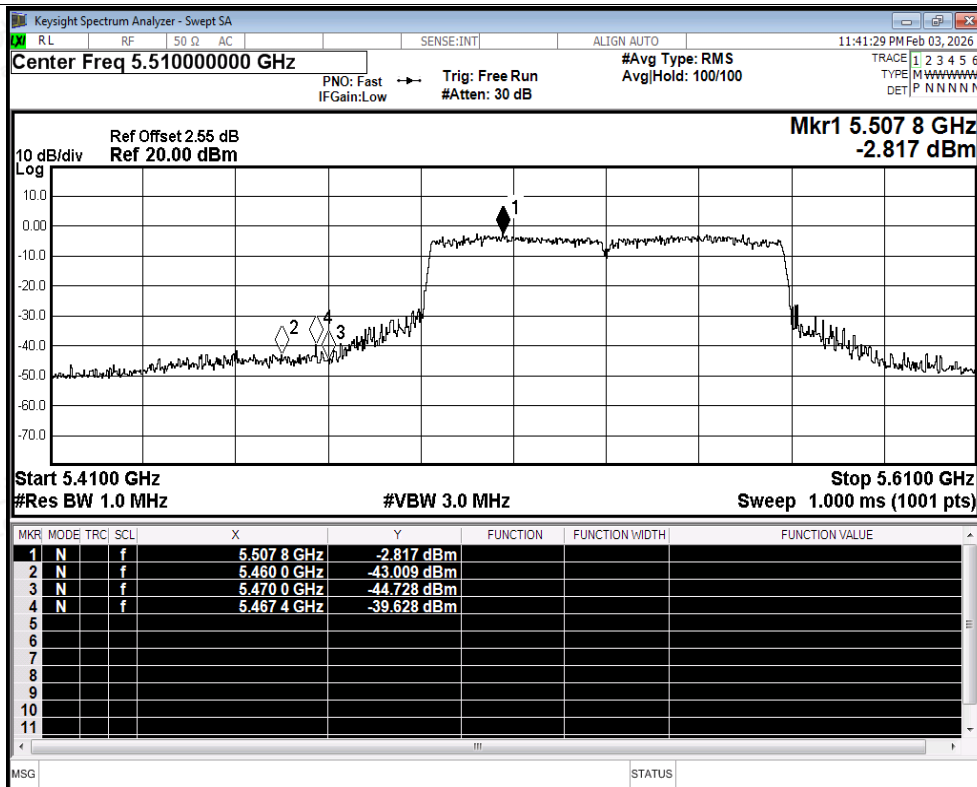

Restrict Band NVNT ac80 5530MHz Ant1 Peak

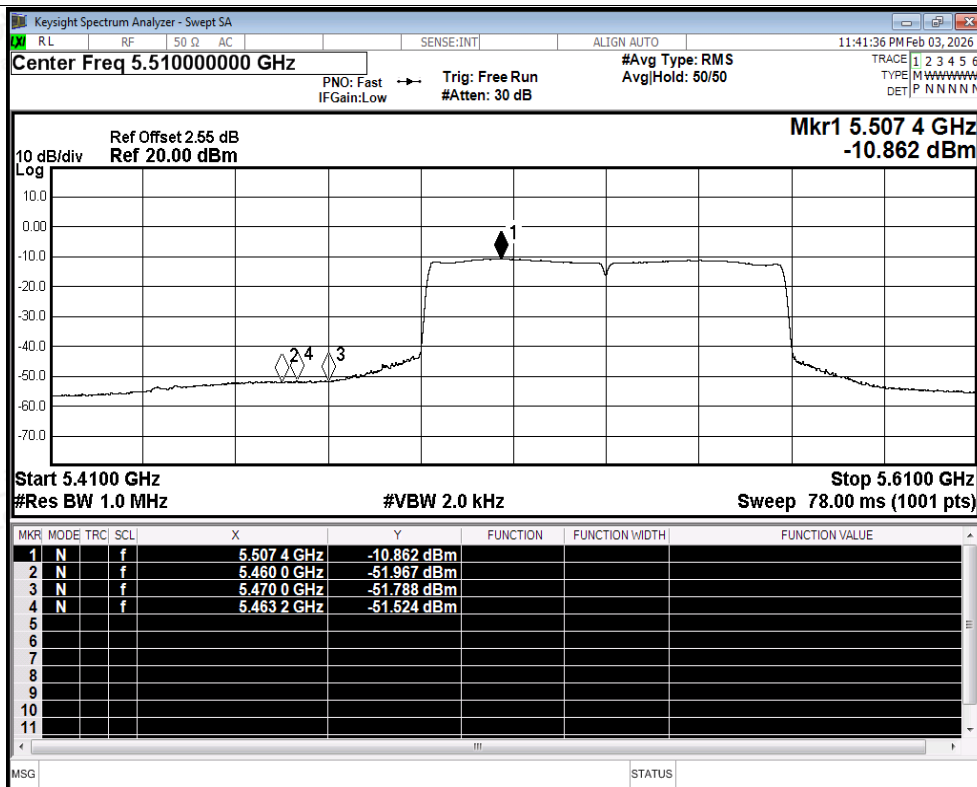

Restrict Band NVNT ac80 5530MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

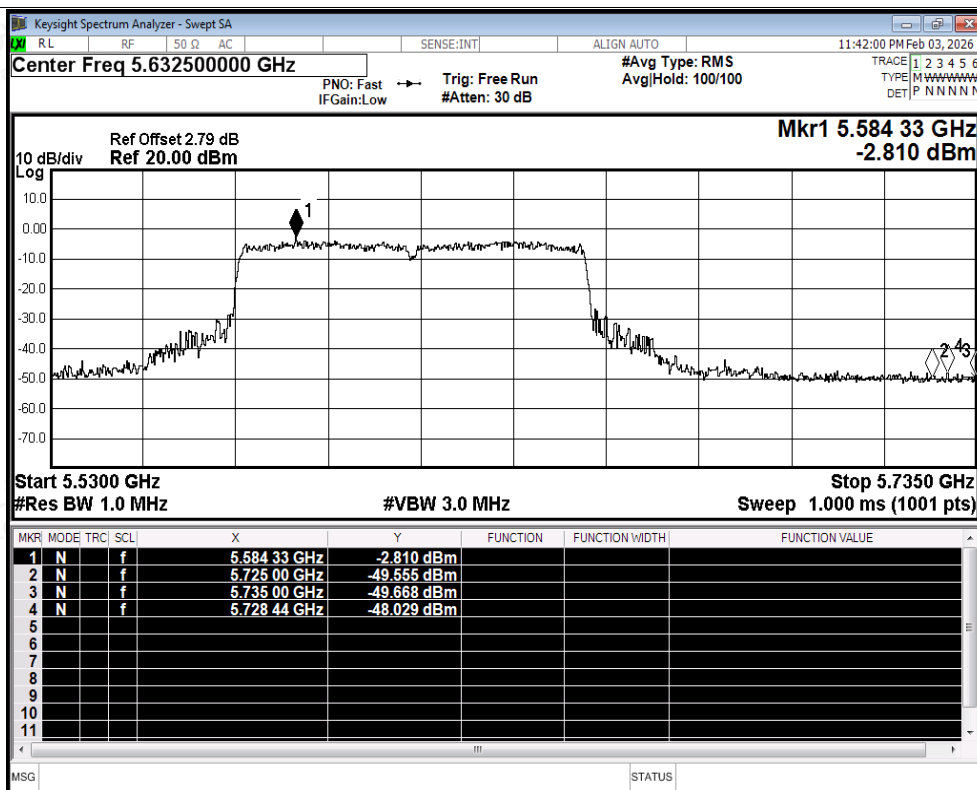

Restrict Band NVNT ac80 5610MHz Ant1 Peak

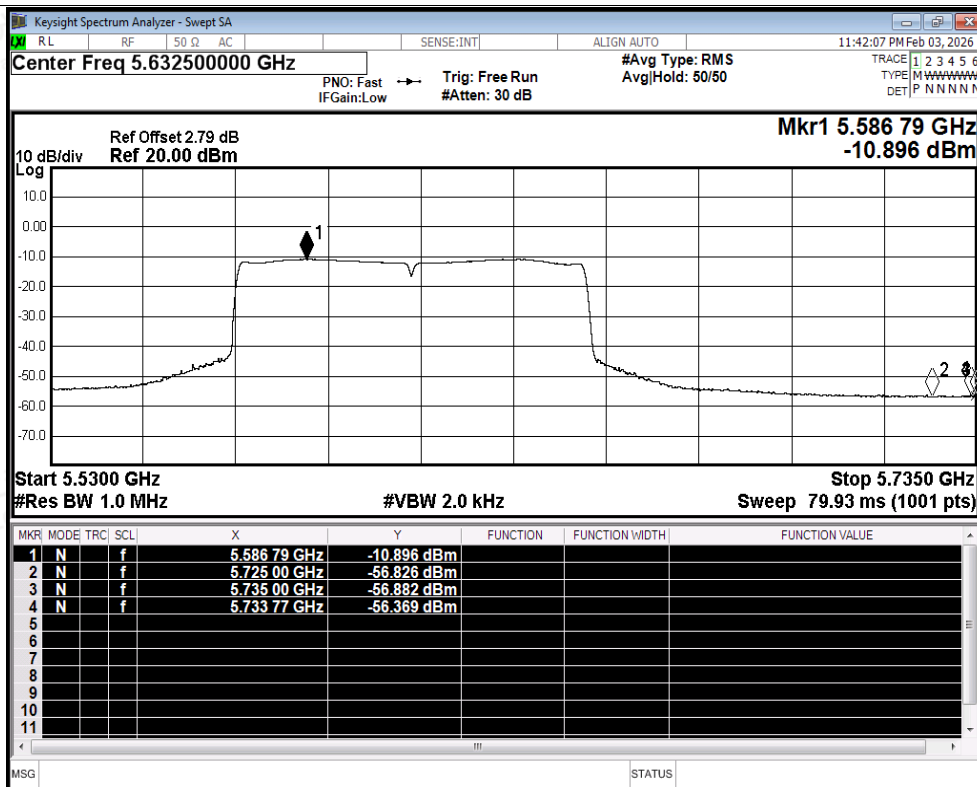

Restrict Band NVNT ac80 5610MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

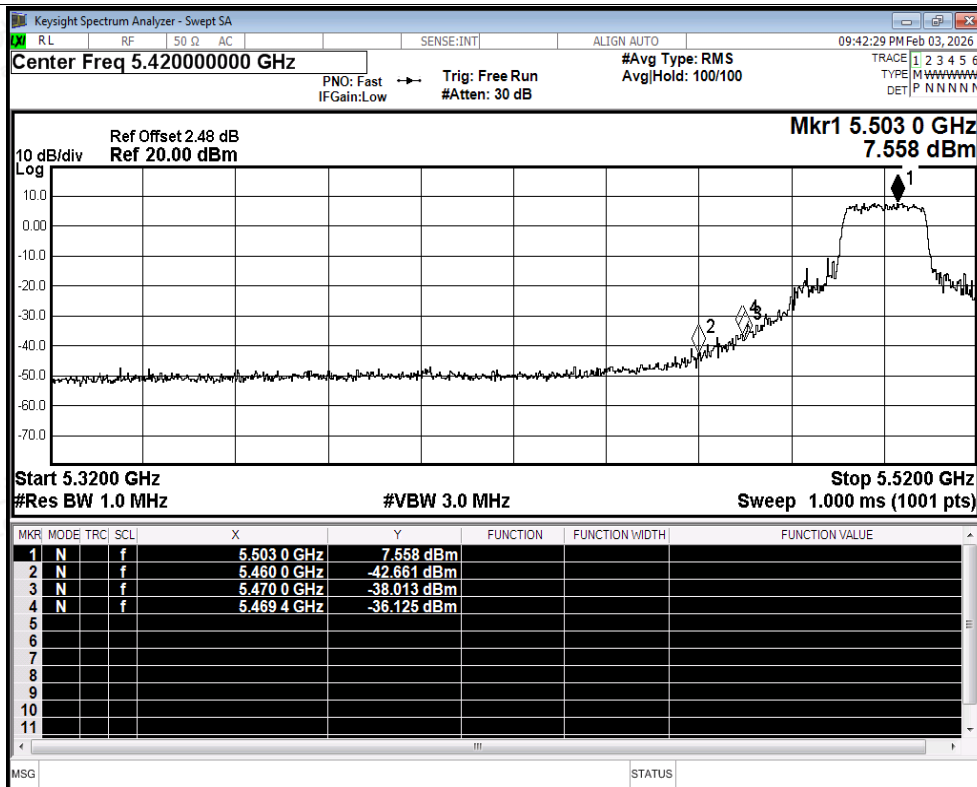

Restrict Band NVNT ax20 5500MHz Ant1 Peak

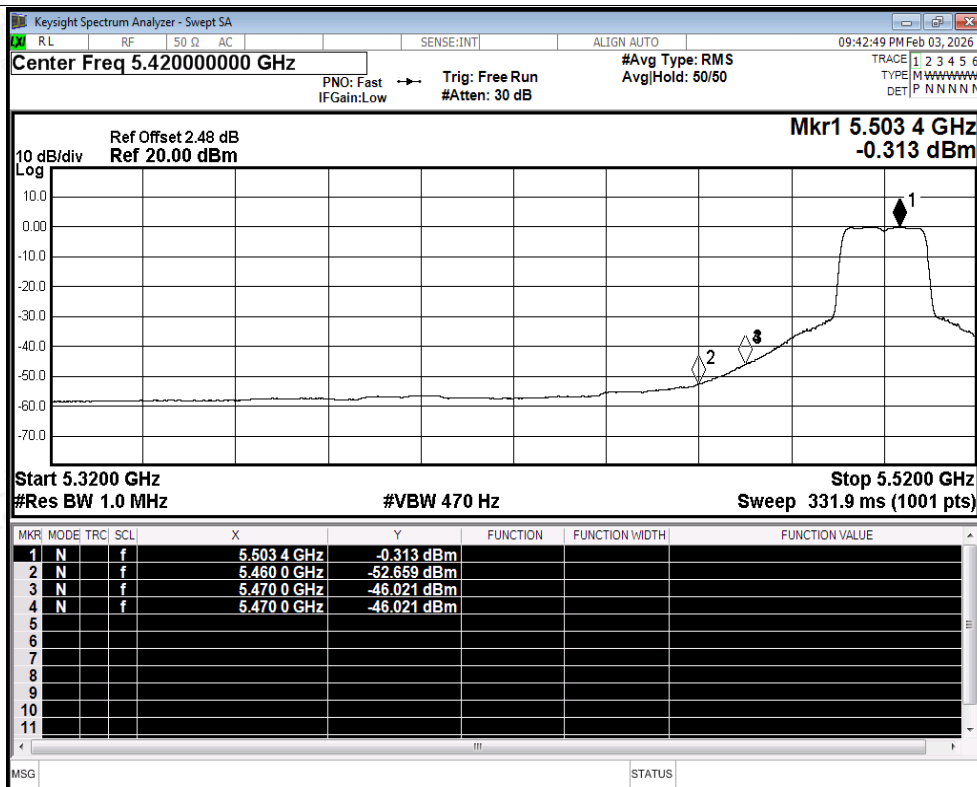

Restrict Band NVNT ax20 5500MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

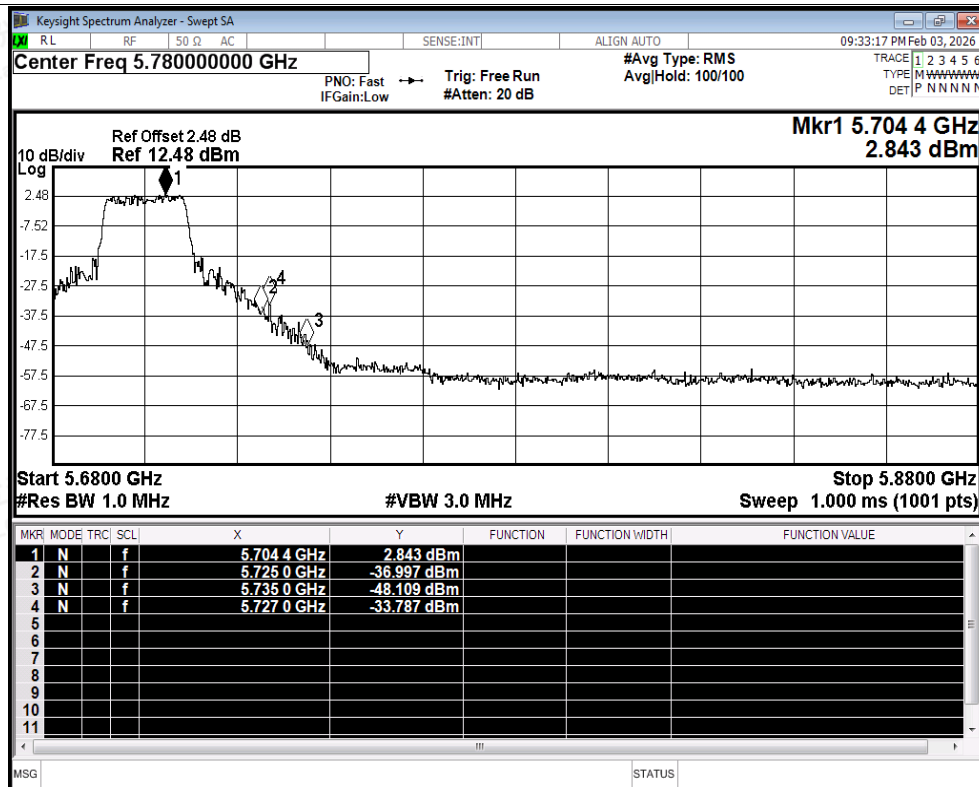

Restrict Band NVNT ax20 5700MHz Ant1 Peak

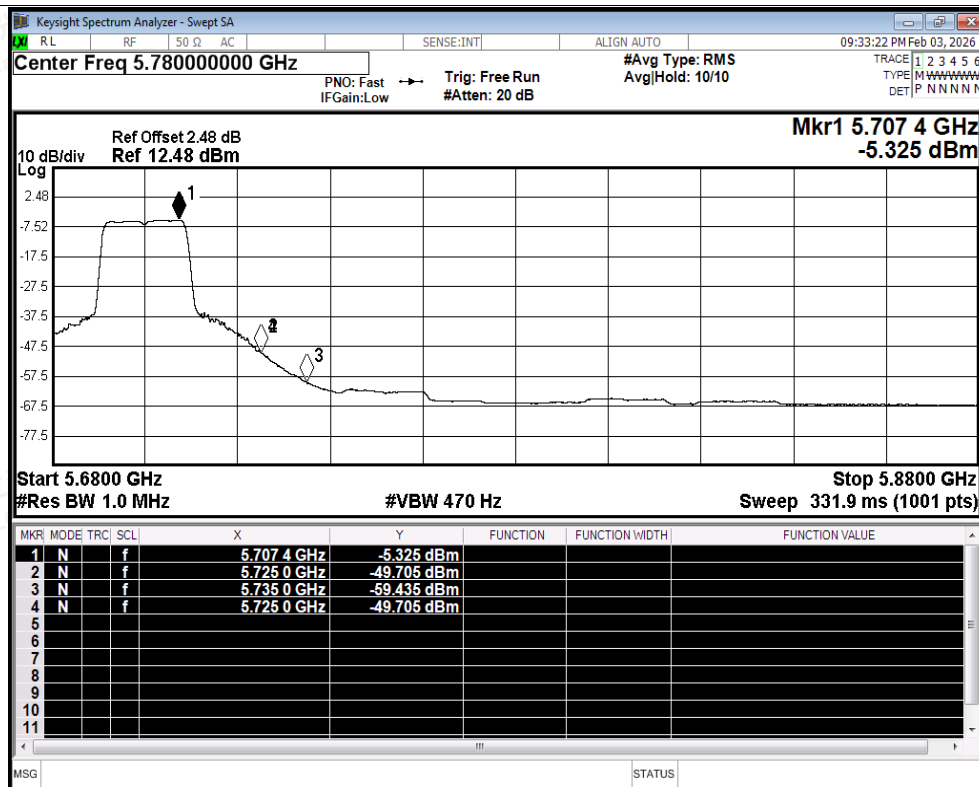

Restrict Band NVNT ax20 5700MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

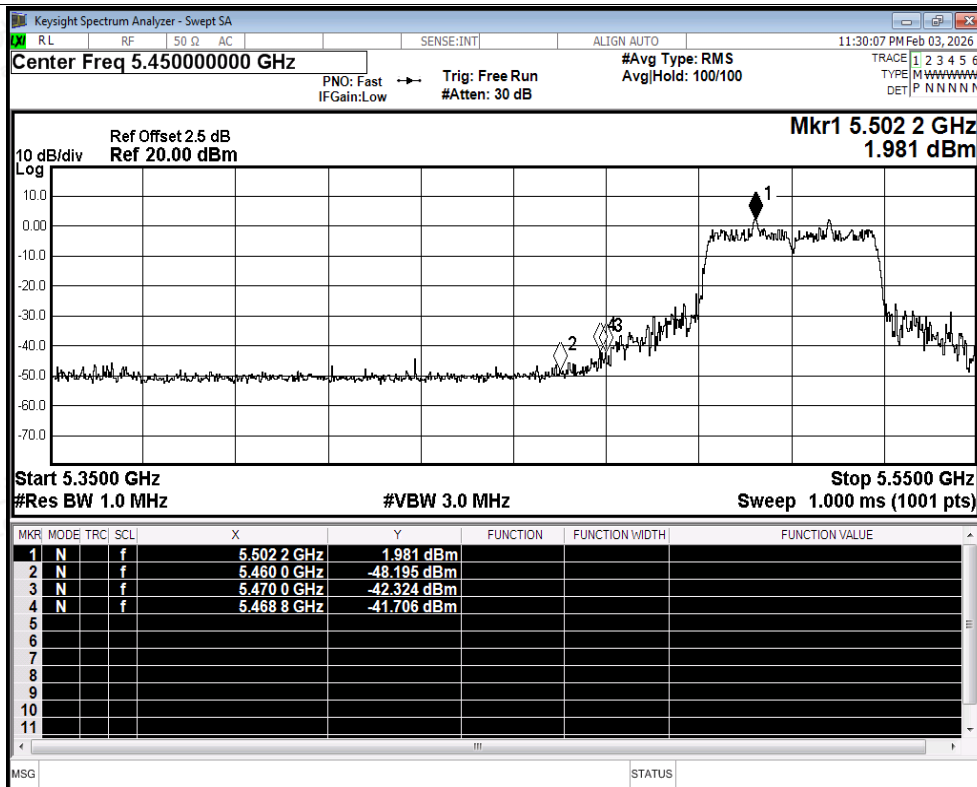

Restrict Band NVNT ax40 5510MHz Ant1 Peak

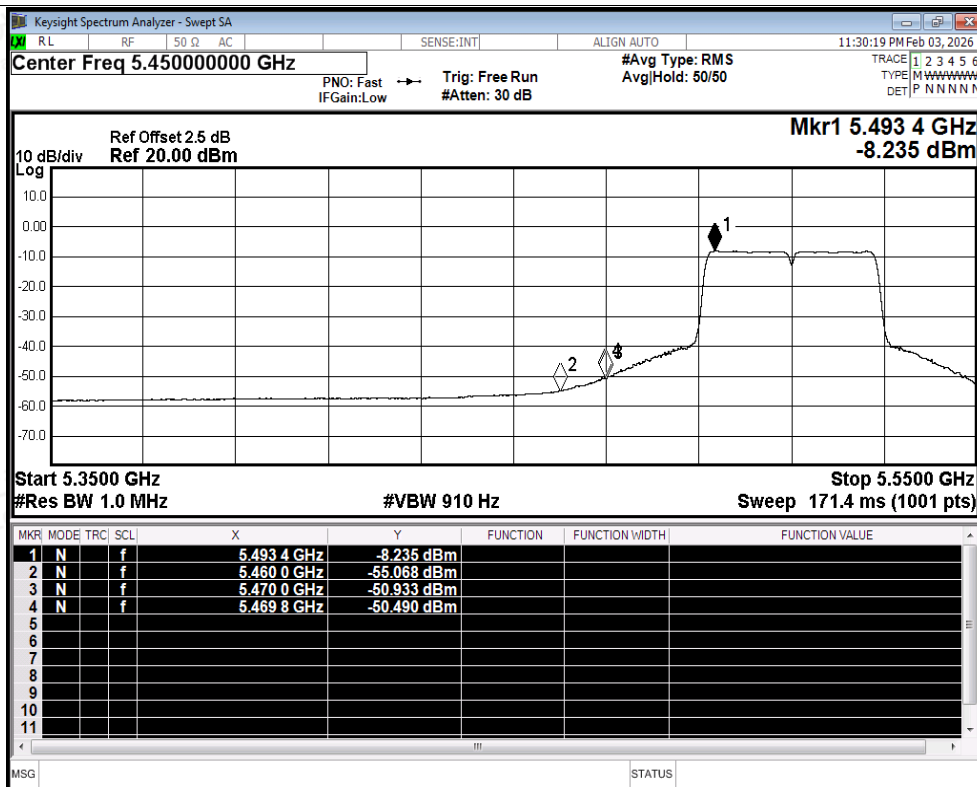

Restrict Band NVNT ax40 5510MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

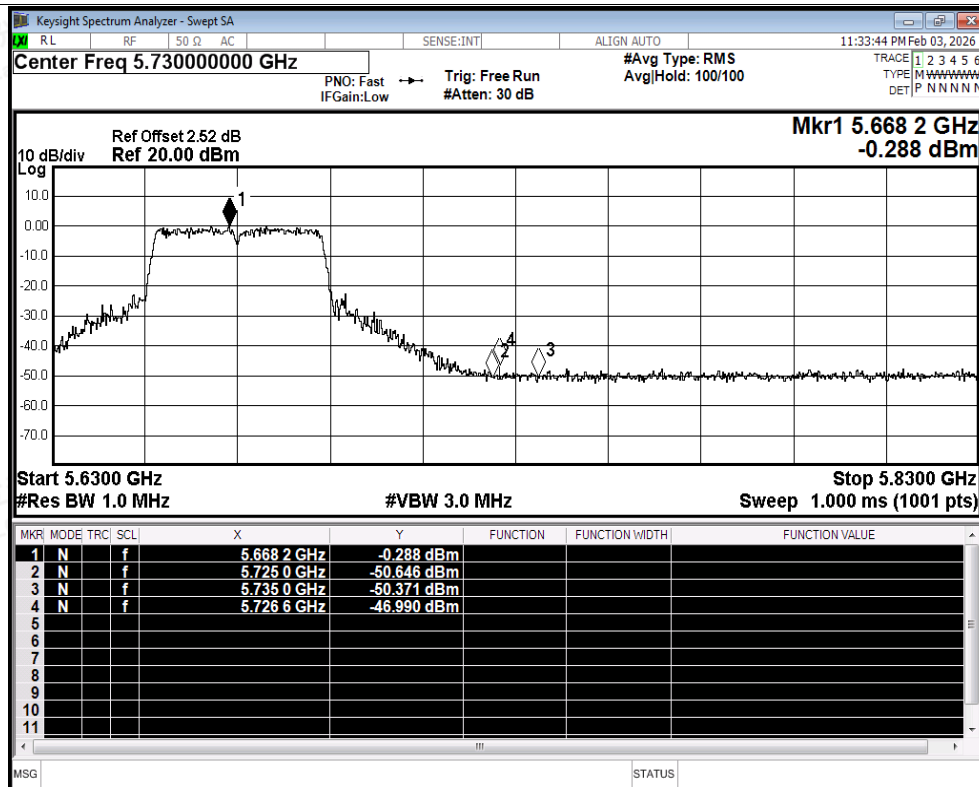

Restrict Band NVNT ax40 5670MHz Ant1 Peak

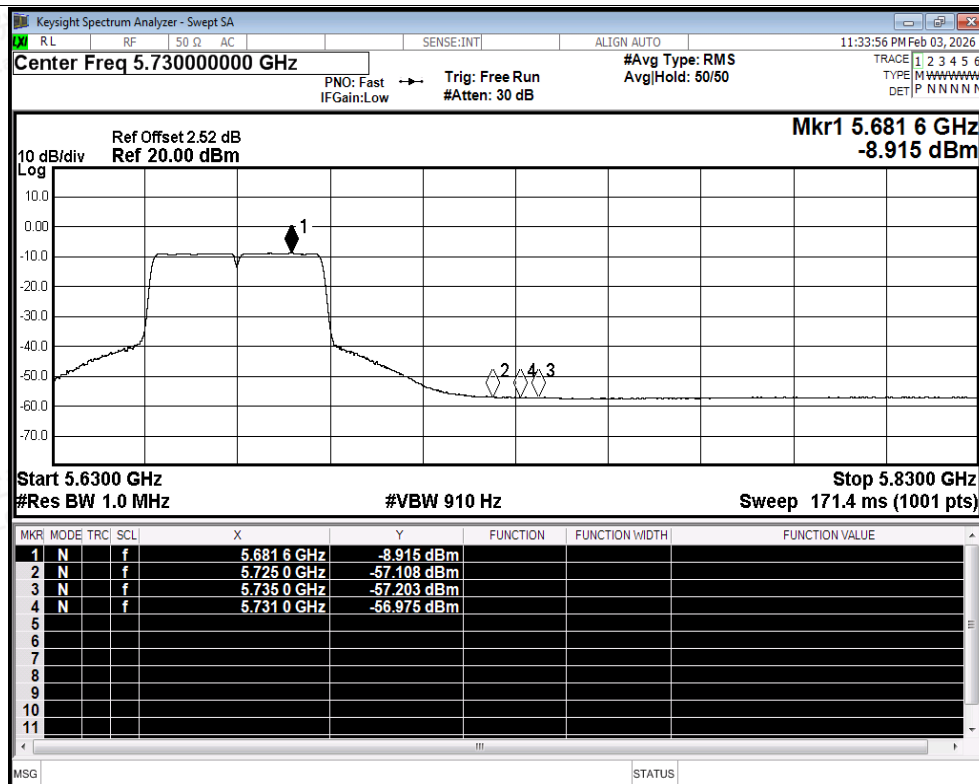

Restrict Band NVNT ax40 5670MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

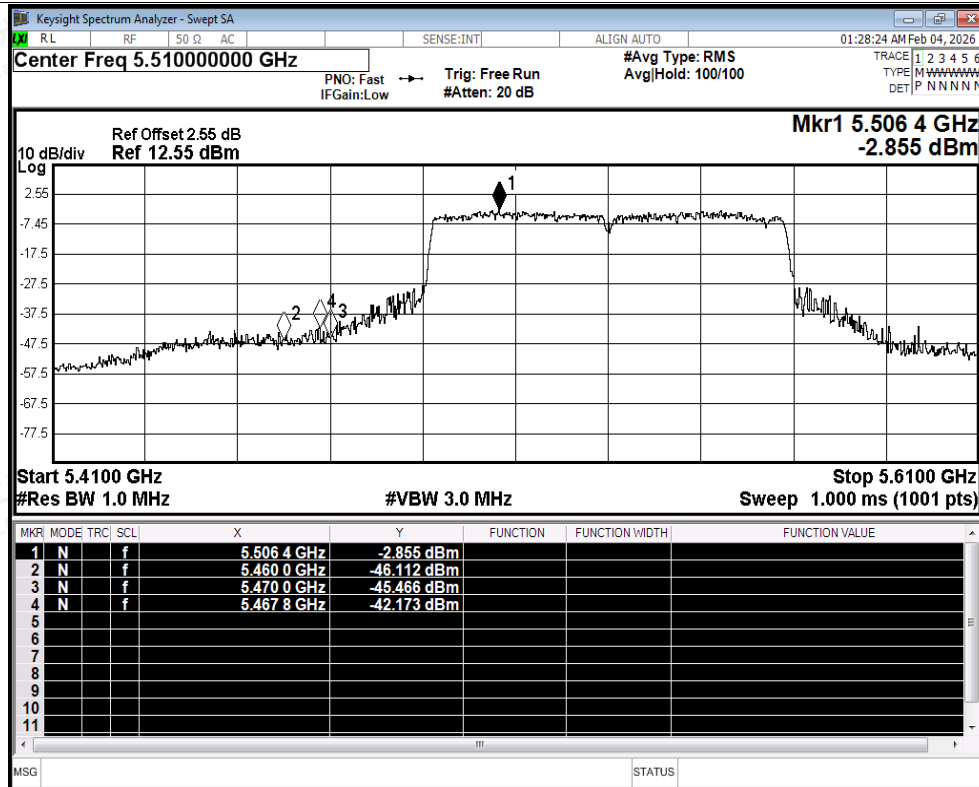

Restrict Band NVNT ax80 5530MHz Ant1 Peak

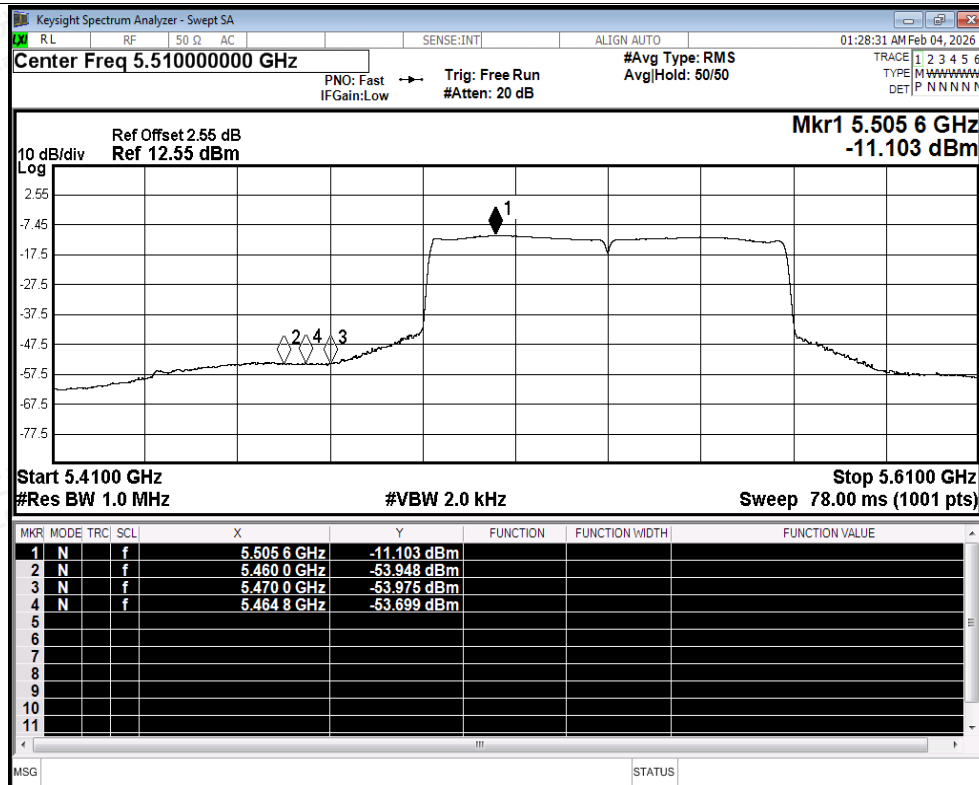

Restrict Band NVNT ax80 5530MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

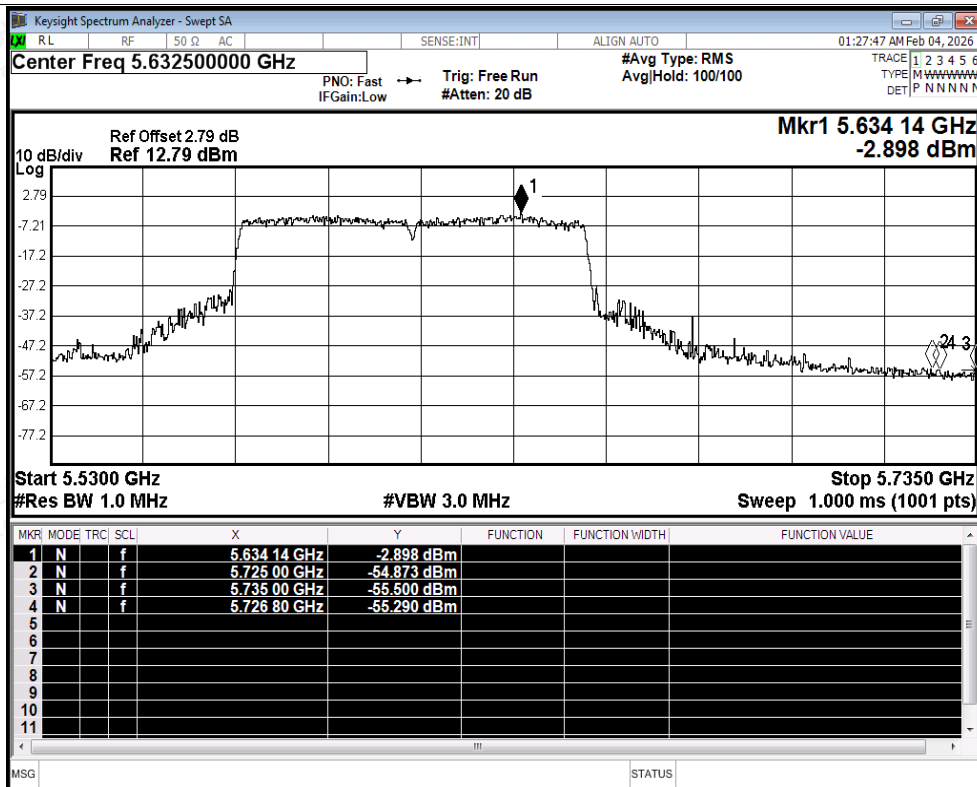

Restrict Band NVNT ax80 5610MHz Ant1 Peak

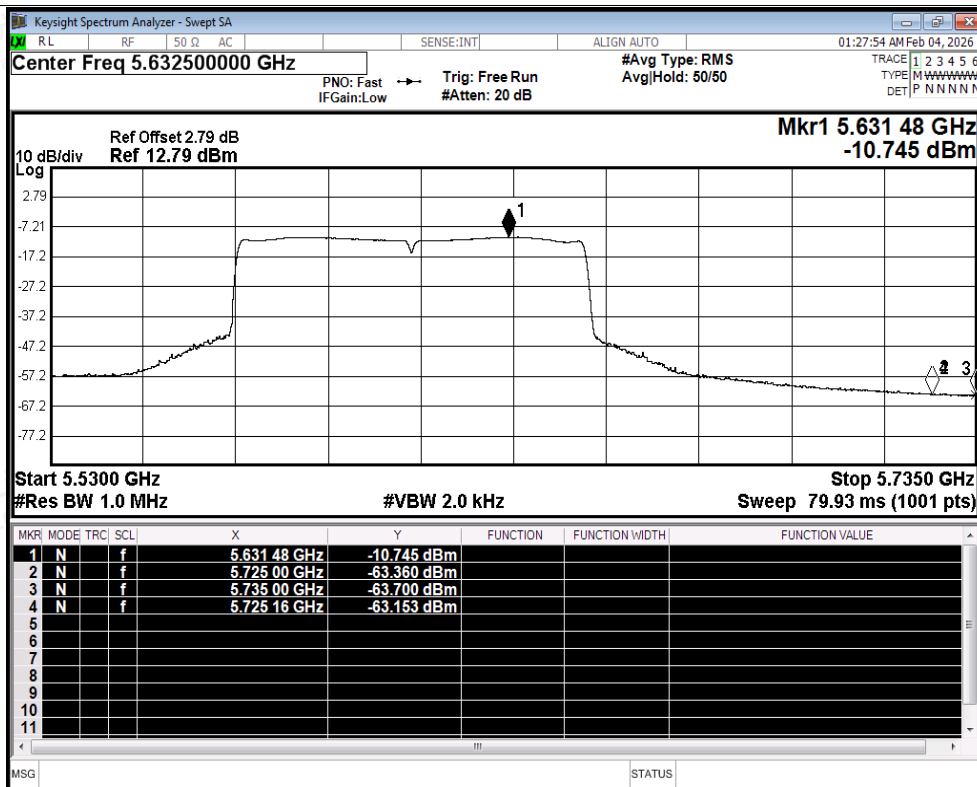

Restrict Band NVNT ax80 5610MHz Ant1 Average



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5500	Ant2	5460	-44.05	5.58	56.76	Peak	68.2	Pass
NVNT	a	5500	Ant2	5460	-50.6	5.58	50.21	Average	54	Pass
NVNT	a	5500	Ant2	5470	-33.82	5.58	66.99	Peak	68.2	Pass
NVNT	a	5500	Ant2	5470	-47.32	5.58	53.49	Average	54	Pass
NVNT	a	5500	Ant2	5470	-33.82	5.58	66.99	Peak	68.2	Pass
NVNT	a	5500	Ant2	5470	-47.32	5.58	53.49	Average	54	Pass
NVNT	a	5700	Ant2	5725	-36.04	5.58	64.77	Peak	68.2	Pass
NVNT	a	5700	Ant2	5725	-49.27	5.58	51.54	Average	54	Pass
NVNT	a	5700	Ant2	5728.8	-34.97	5.58	65.84	Peak	68.2	Pass
NVNT	a	5700	Ant2	5725	-49.27	5.58	51.54	Average	54	Pass
NVNT	a	5700	Ant2	5735	-46.72	5.58	54.09	Peak	68.2	Pass
NVNT	a	5700	Ant2	5735	-57.29	5.58	43.52	Average	54	Pass
NVNT	n20	5500	Ant2	5460	-42.67	5.58	58.14	Peak	68.2	Pass
NVNT	n20	5500	Ant2	5460	-51.33	5.58	49.48	Average	54	Pass
NVNT	n20	5500	Ant2	5469.2	-37.61	5.58	63.20	Peak	68.2	Pass
NVNT	n20	5500	Ant2	5470	-48.45	5.58	52.36	Average	54	Pass
NVNT	n20	5500	Ant2	5470	-39.6	5.58	61.21	Peak	68.2	Pass
NVNT	n20	5500	Ant2	5470	-48.45	5.58	52.36	Average	54	Pass
NVNT	n20	5700	Ant2	5725	-35.09	5.58	65.72	Peak	68.2	Pass
NVNT	n20	5700	Ant2	5725	-48.66	5.58	52.15	Average	54	Pass
NVNT	n20	5700	Ant2	5725.6	-33.74	5.58	67.07	Peak	68.2	Pass
NVNT	n20	5700	Ant2	5725.2	-48.65	5.58	52.16	Average	54	Pass
NVNT	n20	5700	Ant2	5735	-48.12	5.58	52.69	Peak	68.2	Pass
NVNT	n20	5700	Ant2	5735	-57.14	5.58	43.67	Average	54	Pass
NVNT	n40	5510	Ant2	5460	-50.34	5.58	50.47	Peak	68.2	Pass
NVNT	n40	5510	Ant2	5460	-57.21	5.58	43.60	Average	54	Pass
NVNT	n40	5510	Ant2	5466	-36.35	5.58	64.46	Peak	68.2	Pass
NVNT	n40	5510	Ant2	5470	-49.27	5.58	51.54	Average	54	Pass
NVNT	n40	5510	Ant2	5470	-42.18	5.58	58.63	Peak	68.2	Pass
NVNT	n40	5510	Ant2	5470	-49.27	5.58	51.54	Average	54	Pass
NVNT	n40	5670	Ant2	5725	-44.79	5.58	56.02	Peak	68.2	Pass
NVNT	n40	5670	Ant2	5725	-51.38	5.58	49.43	Average	54	Pass
NVNT	n40	5670	Ant2	5727.2	-42.97	5.58	57.84	Peak	68.2	Pass
NVNT	n40	5670	Ant2	5725	-51.38	5.58	49.43	Average	54	Pass
NVNT	n40	5670	Ant2	5735	-44.48	5.58	56.33	Peak	68.2	Pass
NVNT	n40	5670	Ant2	5735	-51.64	5.58	49.17	Average	54	Pass
NVNT	ac20	5500	Ant2	5460	-49.48	5.58	51.33	Peak	68.2	Pass
NVNT	ac20	5500	Ant2	5460	-57.41	5.58	43.40	Average	54	Pass
NVNT	ac20	5500	Ant2	5469.2	-36.28	5.58	64.53	Peak	68.2	Pass
NVNT	ac20	5500	Ant2	5470	-50.95	5.58	49.86	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5500	Ant2	5470	-36.65	5.58	64.16	Peak	68.2	Pass
NVNT	ac20	5500	Ant2	5470	-50.95	5.58	49.86	Average	54	Pass
NVNT	ac20	5700	Ant2	5725	-35.85	5.58	64.96	Peak	68.2	Pass
NVNT	ac20	5700	Ant2	5725	-48.14	5.58	52.67	Average	54	Pass
NVNT	ac20	5700	Ant2	5725.2	-33.42	5.58	67.39	Peak	68.2	Pass
NVNT	ac20	5700	Ant2	5725	-48.14	5.58	52.67	Average	54	Pass
NVNT	ac20	5700	Ant2	5735	-45.09	5.58	55.72	Peak	68.2	Pass
NVNT	ac20	5700	Ant2	5735	-57.32	5.58	43.49	Average	54	Pass
NVNT	ac40	5510	Ant2	5460	-44.77	5.58	56.04	Peak	68.2	Pass
NVNT	ac40	5510	Ant2	5460	-50.84	5.58	49.97	Average	54	Pass
NVNT	ac40	5510	Ant2	5469.8	-36.94	5.58	63.87	Peak	68.2	Pass
NVNT	ac40	5510	Ant2	5470	-47.93	5.58	52.88	Average	54	Pass
NVNT	ac40	5510	Ant2	5470	-38.74	5.58	62.07	Peak	68.2	Pass
NVNT	ac40	5510	Ant2	5470	-47.93	5.58	52.88	Average	54	Pass
NVNT	ac40	5670	Ant2	5725	-46.12	5.58	54.69	Peak	68.2	Pass
NVNT	ac40	5670	Ant2	5725	-52.13	5.58	48.68	Average	54	Pass
NVNT	ac40	5670	Ant2	5725.4	-41.08	5.58	59.73	Peak	68.2	Pass
NVNT	ac40	5670	Ant2	5726.8	-52.12	5.58	48.69	Average	54	Pass
NVNT	ac40	5670	Ant2	5735	-44.38	5.58	56.43	Peak	68.2	Pass
NVNT	ac40	5670	Ant2	5735	-52.14	5.58	48.67	Average	54	Pass
NVNT	ac80	5530	Ant2	5460	-43.01	5.58	57.80	Peak	68.2	Pass
NVNT	ac80	5530	Ant2	5460	-49.52	5.58	51.29	Average	54	Pass
NVNT	ac80	5530	Ant2	5468	-36.23	5.58	64.58	Peak	68.2	Pass
NVNT	ac80	5530	Ant2	5470	-47.89	5.58	52.92	Average	54	Pass
NVNT	ac80	5530	Ant2	5470	-38.57	5.58	62.24	Peak	68.2	Pass
NVNT	ac80	5530	Ant2	5470	-47.89	5.58	52.92	Average	54	Pass
NVNT	ac80	5610	Ant2	5725	-46.16	5.58	54.65	Peak	68.2	Pass
NVNT	ac80	5610	Ant2	5725	-51.14	5.58	49.67	Average	54	Pass
NVNT	ac80	5610	Ant2	5729.875	-42.56	5.58	58.25	Peak	68.2	Pass
NVNT	ac80	5610	Ant2	5729.875	-50.88	5.58	49.93	Average	54	Pass
NVNT	ac80	5610	Ant2	5735	-43.82	5.58	56.99	Peak	68.2	Pass
NVNT	ac80	5610	Ant2	5735	-51.27	5.58	49.54	Average	54	Pass
NVNT	ax20	5500	Ant2	5460	-44.57	5.58	56.24	Peak	68.2	Pass
NVNT	ax20	5500	Ant2	5460	-51.83	5.58	48.98	Average	54	Pass
NVNT	ax20	5500	Ant2	5468.2	-37.9	5.58	62.91	Peak	68.2	Pass
NVNT	ax20	5500	Ant2	5470	-50.31	5.58	50.50	Average	54	Pass
NVNT	ax20	5500	Ant2	5470	-38.98	5.58	61.83	Peak	68.2	Pass
NVNT	ax20	5500	Ant2	5470	-50.31	5.58	50.50	Average	54	Pass
NVNT	ax20	5700	Ant2	5725	-33.19	5.58	67.62	Peak	68.2	Pass
NVNT	ax20	5700	Ant2	5725	-48.43	5.58	52.38	Average	54	Pass
NVNT	ax20	5700	Ant2	5725	-33.19	5.58	67.62	Peak	68.2	Pass
NVNT	ax20	5700	Ant2	5725	-48.43	5.58	52.38	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax20	5700	Ant2	5735	-46.9	5.58	53.91	Peak	68.2	Pass
NVNT	ax20	5700	Ant2	5735	-57.28	5.58	43.53	Average	54	Pass
NVNT	ax40	5510	Ant2	5460	-44.72	5.58	56.09	Peak	68.2	Pass
NVNT	ax40	5510	Ant2	5460	-50.9	5.58	49.91	Average	54	Pass
NVNT	ax40	5510	Ant2	5469.8	-35.02	5.58	65.79	Peak	68.2	Pass
NVNT	ax40	5510	Ant2	5469.8	-47.51	5.58	53.30	Average	54	Pass
NVNT	ax40	5510	Ant2	5470	-37.96	5.58	62.85	Peak	68.2	Pass
NVNT	ax40	5510	Ant2	5470	-47.56	5.58	53.25	Average	54	Pass
NVNT	ax40	5670	Ant2	5725	-44.82	5.58	55.99	Peak	68.2	Pass
NVNT	ax40	5670	Ant2	5725	-52.13	5.58	48.68	Average	54	Pass
NVNT	ax40	5670	Ant2	5728.4	-42.72	5.58	58.09	Peak	68.2	Pass
NVNT	ax40	5670	Ant2	5726	-52.12	5.58	48.69	Average	54	Pass
NVNT	ax40	5670	Ant2	5735	-44.54	5.58	56.27	Peak	68.2	Pass
NVNT	ax40	5670	Ant2	5735	-52.16	5.58	48.65	Average	54	Pass
NVNT	ax80	5530	Ant2	5460	-44.37	5.58	56.44	Peak	68.2	Pass
NVNT	ax80	5530	Ant2	5460	-51.26	5.58	49.55	Average	54	Pass
NVNT	ax80	5530	Ant2	5469.4	-37.05	5.58	63.76	Peak	68.2	Pass
NVNT	ax80	5530	Ant2	5470	-47.58	5.58	53.23	Average	54	Pass
NVNT	ax80	5530	Ant2	5470	-38.82	5.58	61.99	Peak	68.2	Pass
NVNT	ax80	5530	Ant2	5470	-47.58	5.58	53.23	Average	54	Pass
NVNT	ax80	5610	Ant2	5725	-51.41	5.58	49.40	Peak	68.2	Pass
NVNT	ax80	5610	Ant2	5725	-59.36	5.58	41.45	Average	54	Pass
NVNT	ax80	5610	Ant2	5725.775	-49.46	5.58	51.35	Peak	68.2	Pass
NVNT	ax80	5610	Ant2	5733.77	-59.06	5.58	41.75	Average	54	Pass
NVNT	ax80	5610	Ant2	5735	-52.82	5.58	47.99	Peak	68.2	Pass
NVNT	ax80	5610	Ant2	5735	-59.5	5.58	41.31	Average	54	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

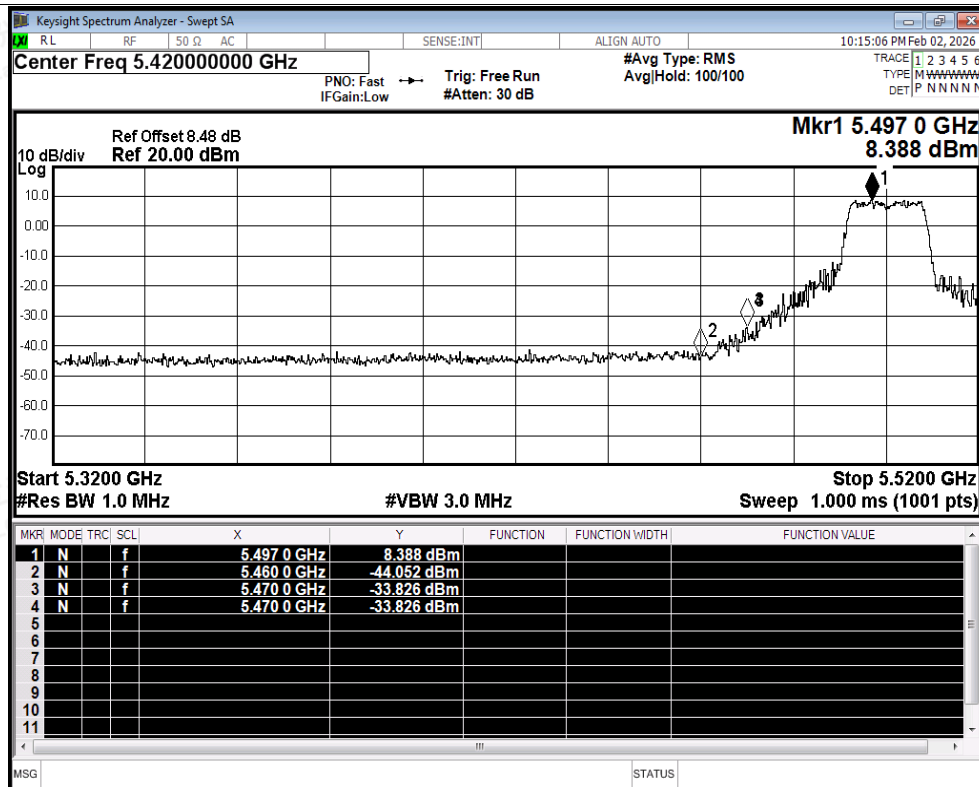

Restrict Band NVNT a 5500MHz Ant2 Peak

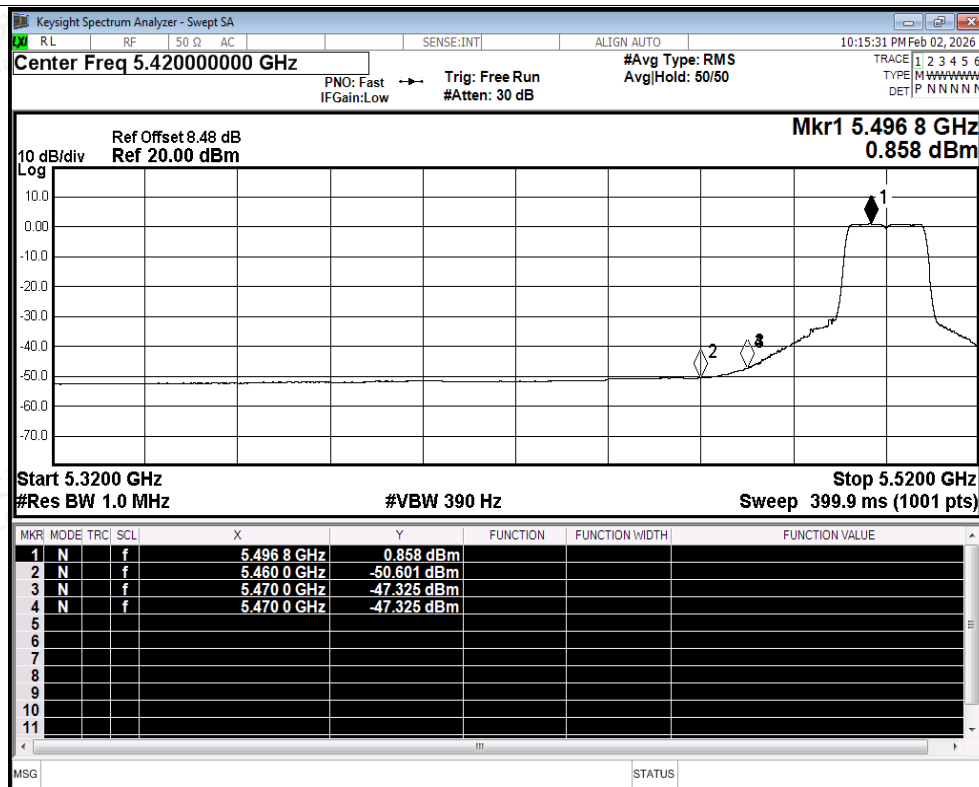

Restrict Band NVNT a 5500MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

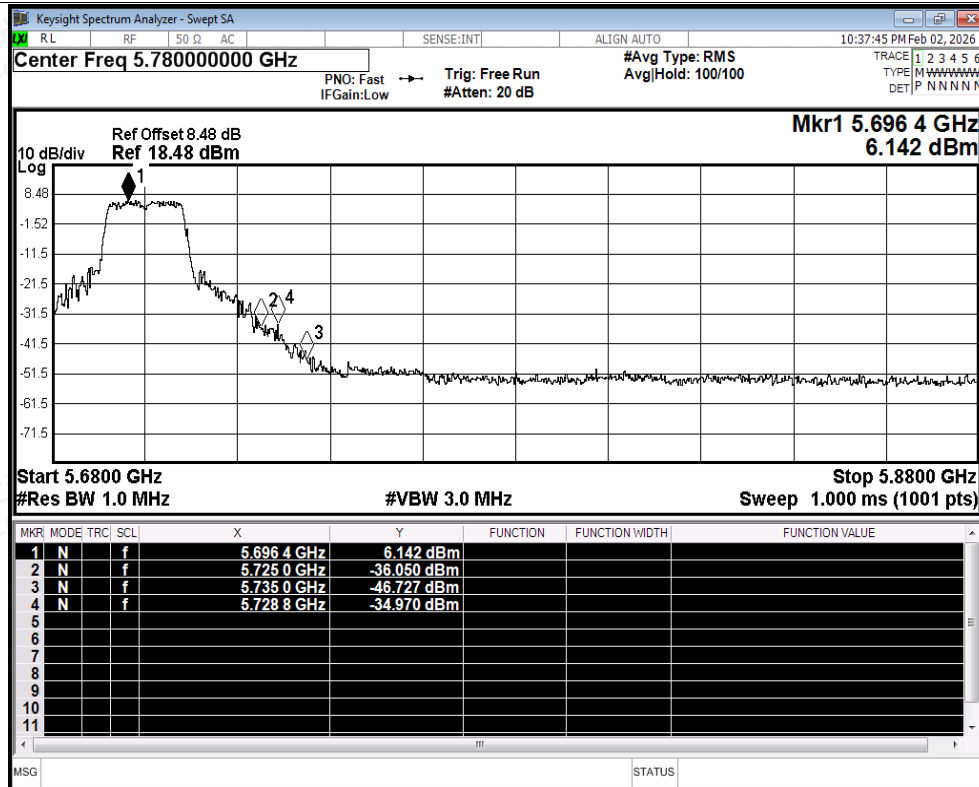

Restrict Band NVNT a 5700MHz Ant2 Peak

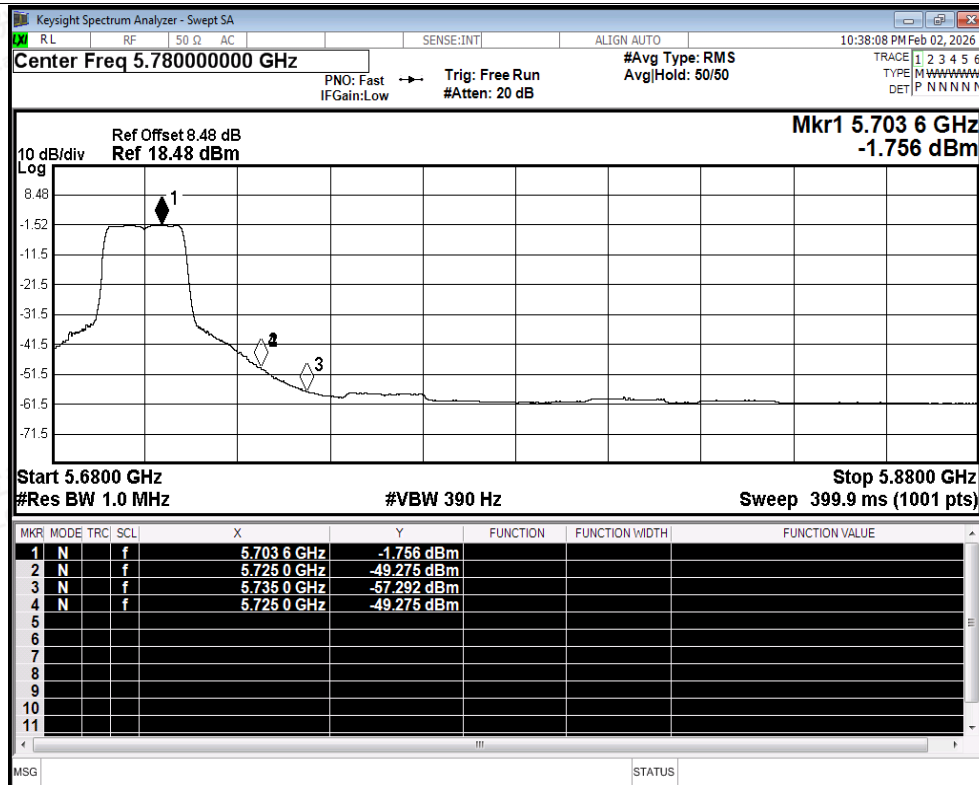

Restrict Band NVNT a 5700MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

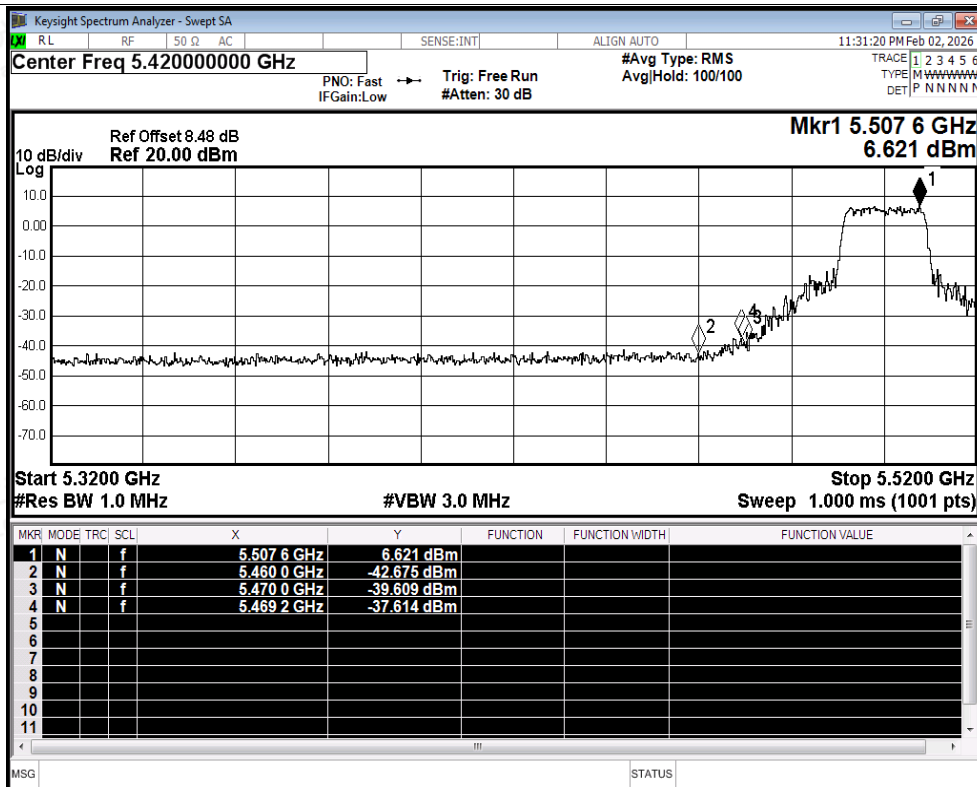

Restrict Band NVNT n20 5500MHz Ant2 Peak

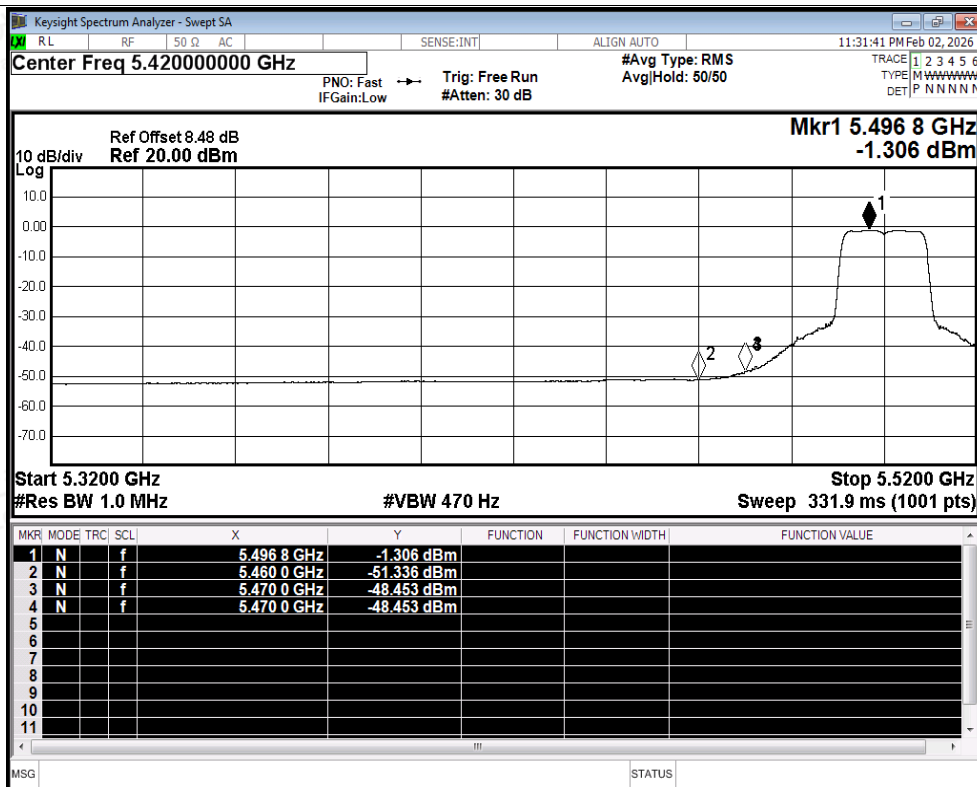

Restrict Band NVNT n20 5500MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

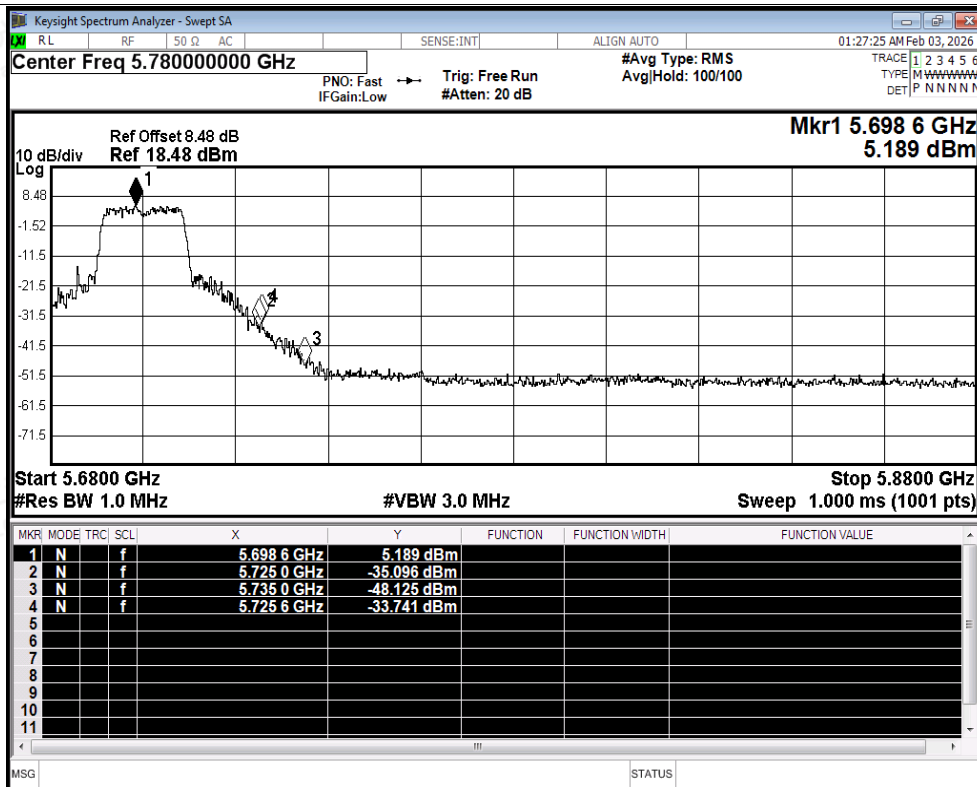

Restrict Band NVNT n20 5700MHz Ant2 Peak

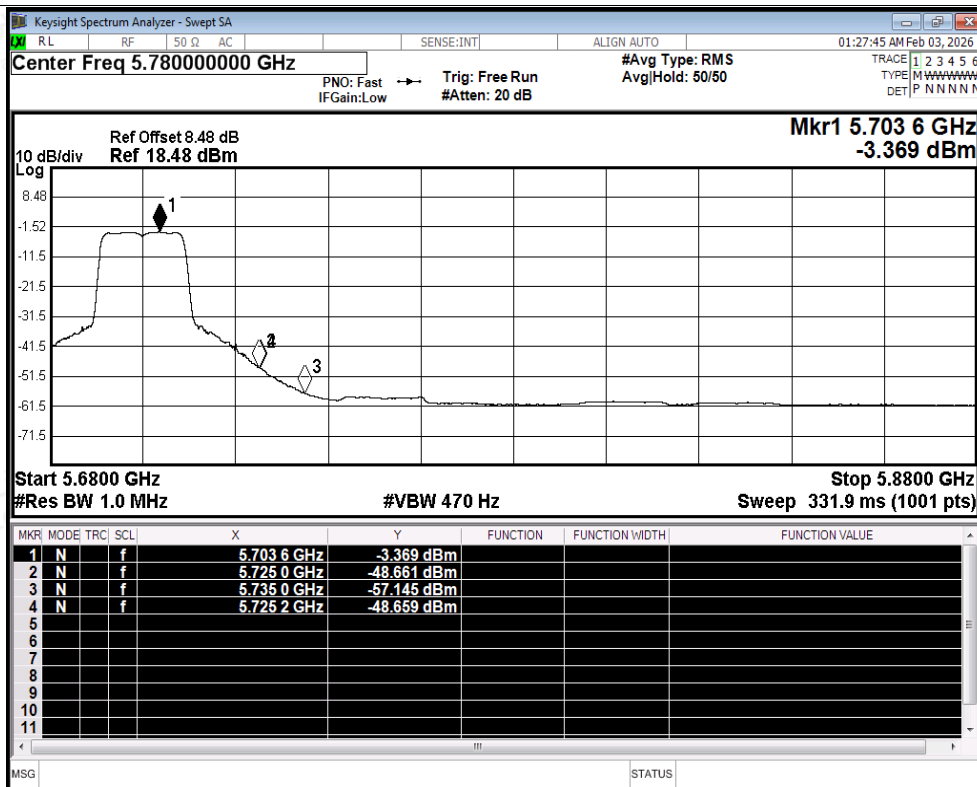

Restrict Band NVNT n20 5700MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

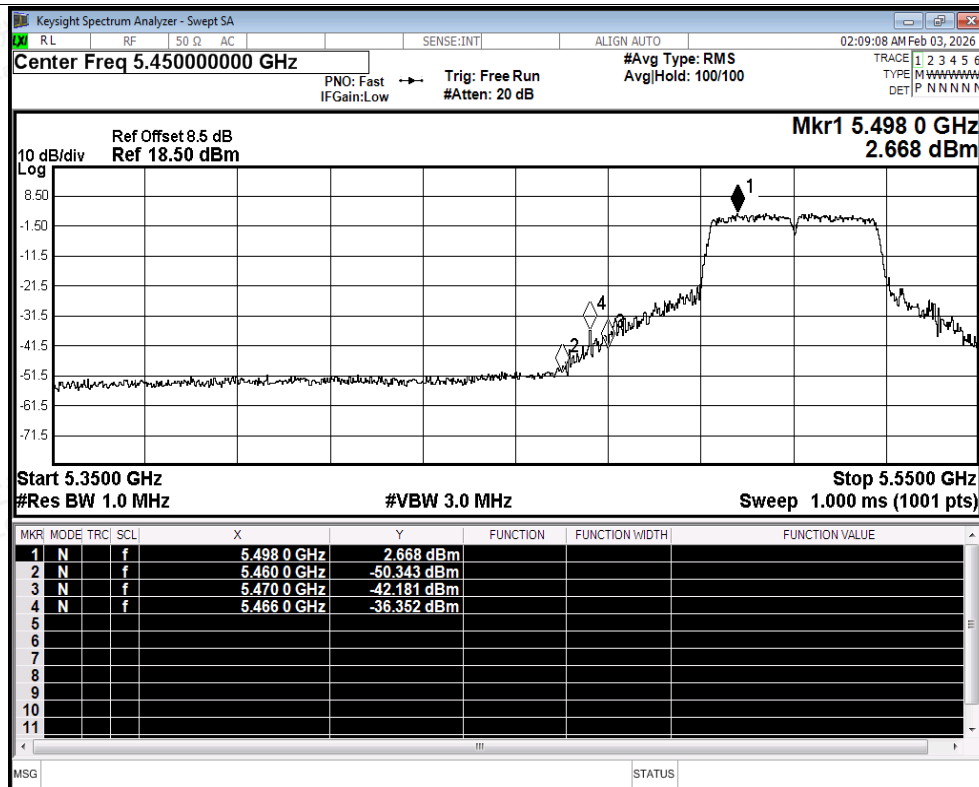

Restrict Band NVNT n40 5510MHz Ant2 Peak

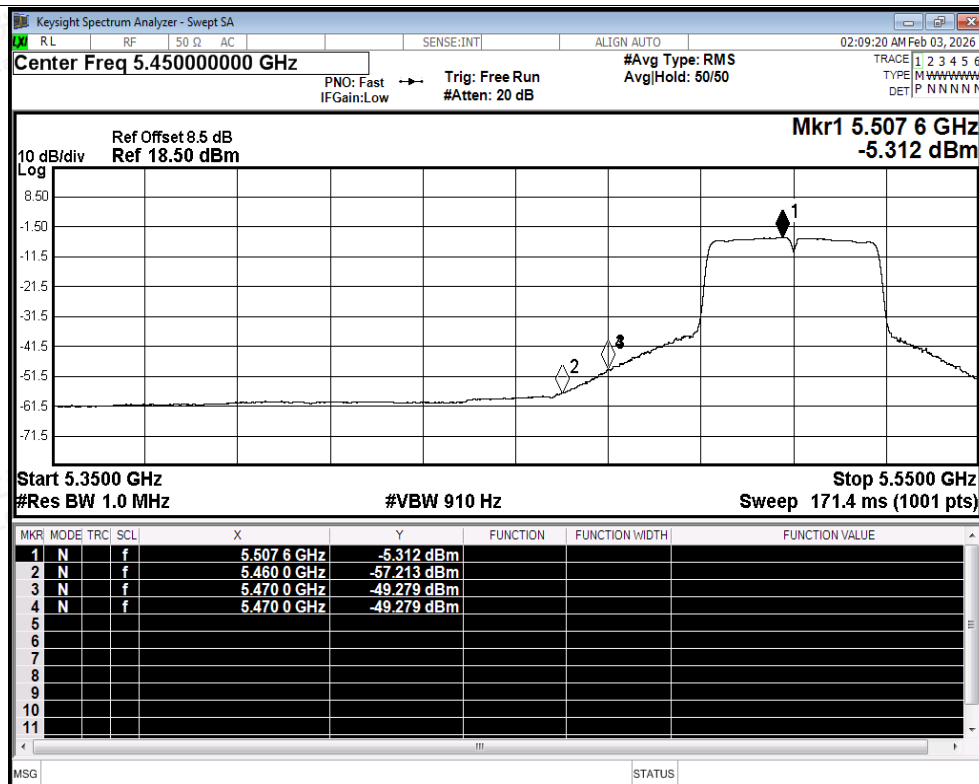

Restrict Band NVNT n40 5510MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

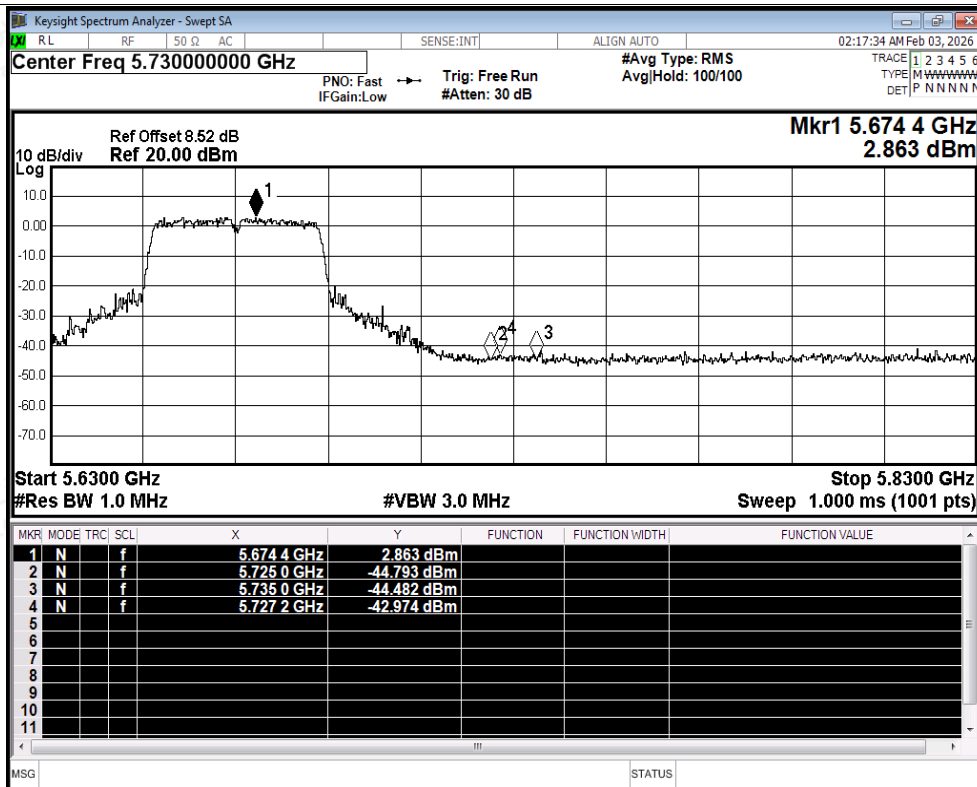

Restrict Band NVNT n40 5670MHz Ant2 Peak

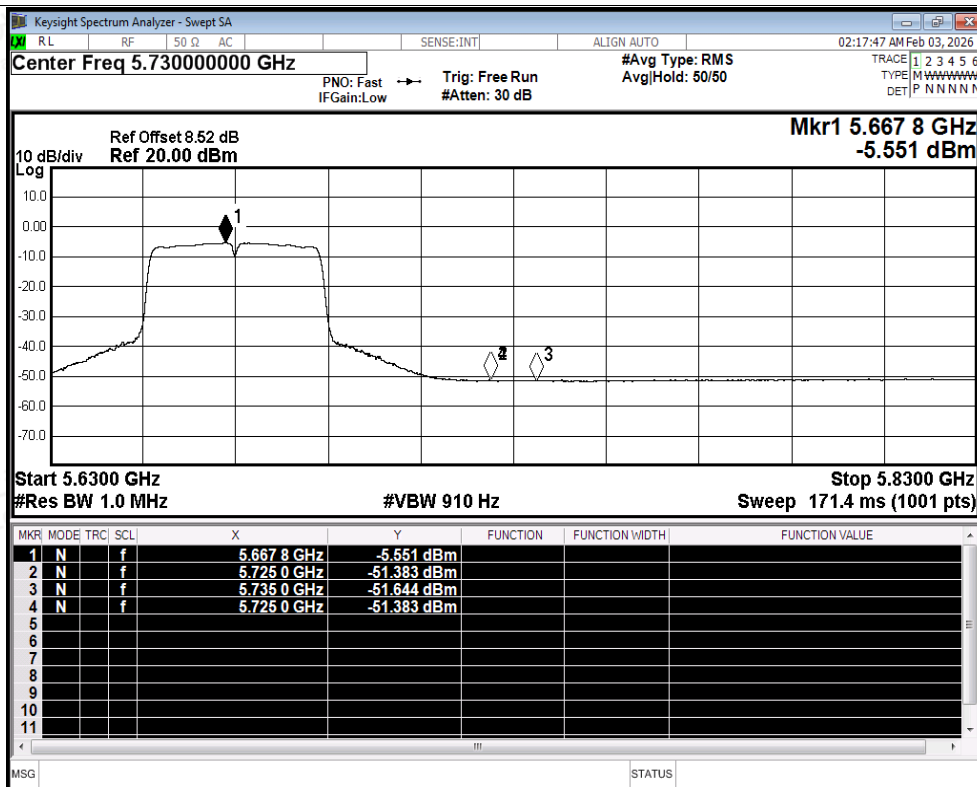

Restrict Band NVNT n40 5670MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

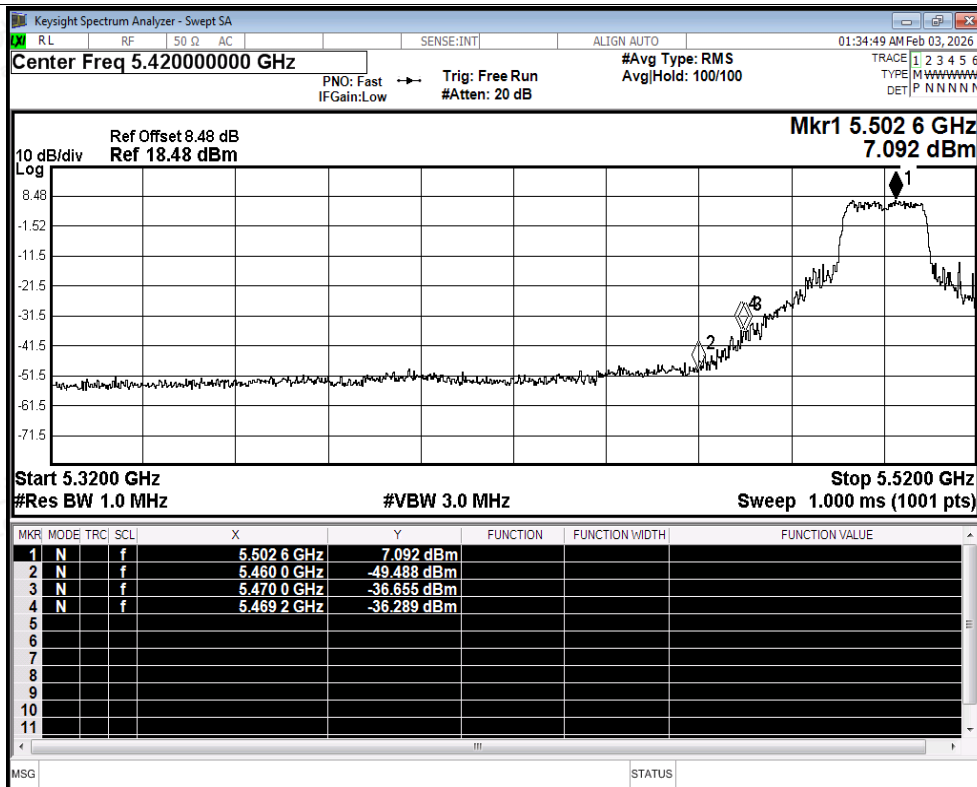

Restrict Band NVNT ac20 5500MHz Ant2 Peak

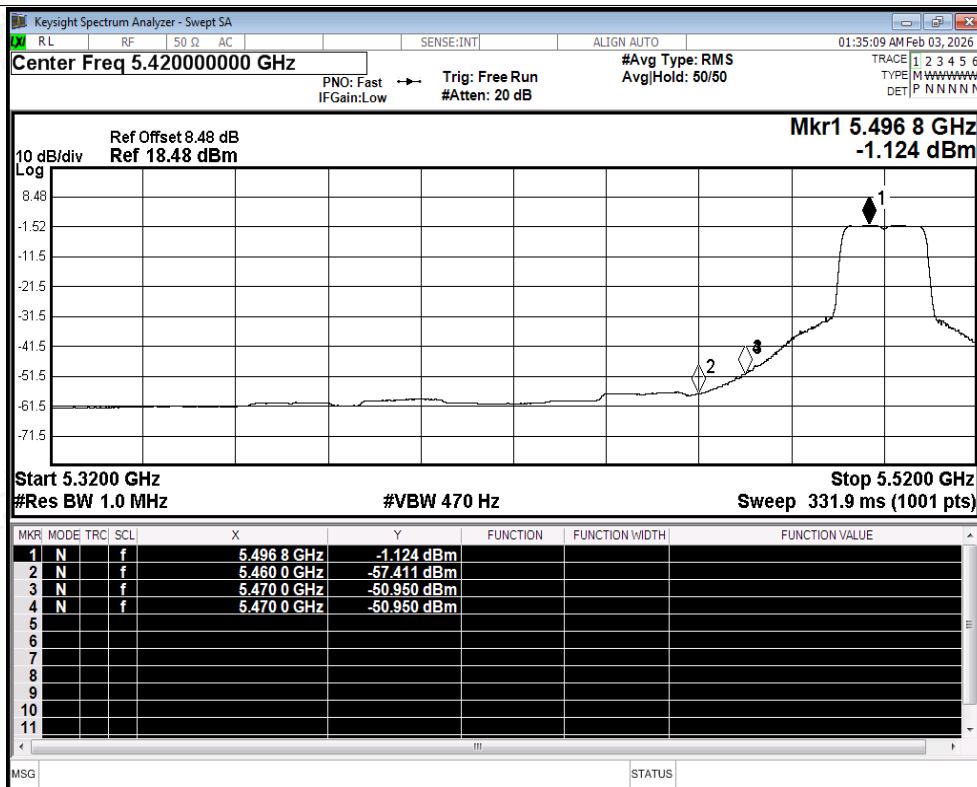

Restrict Band NVNT ac20 5500MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

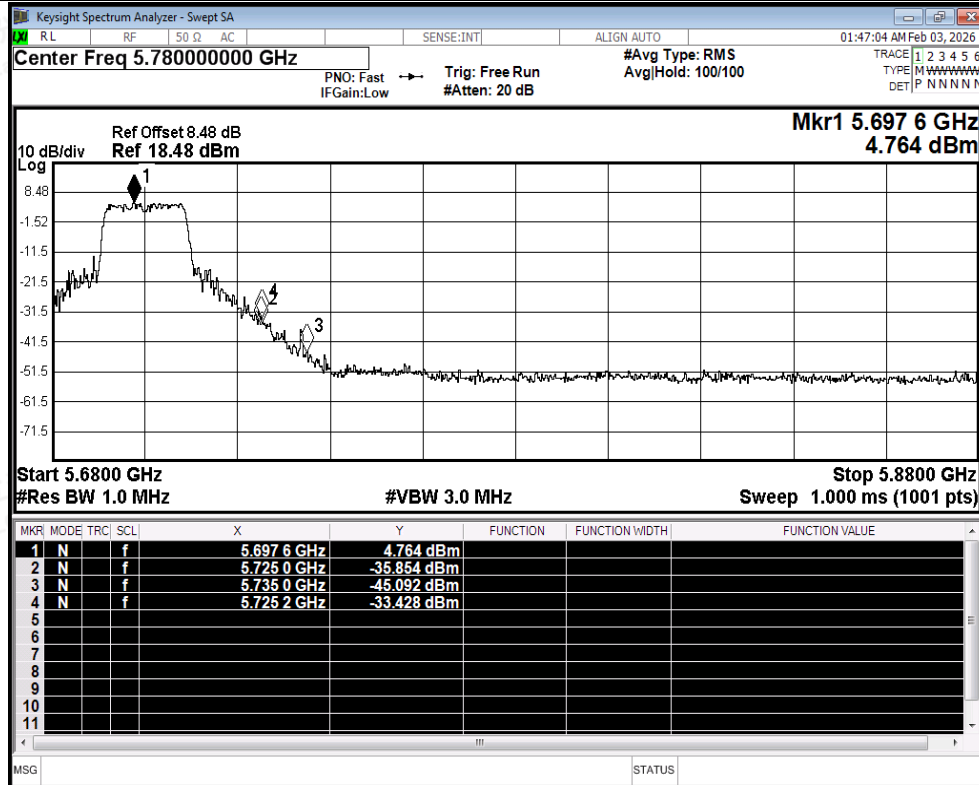

Restrict Band NVNT ac20 5700MHz Ant2 Peak

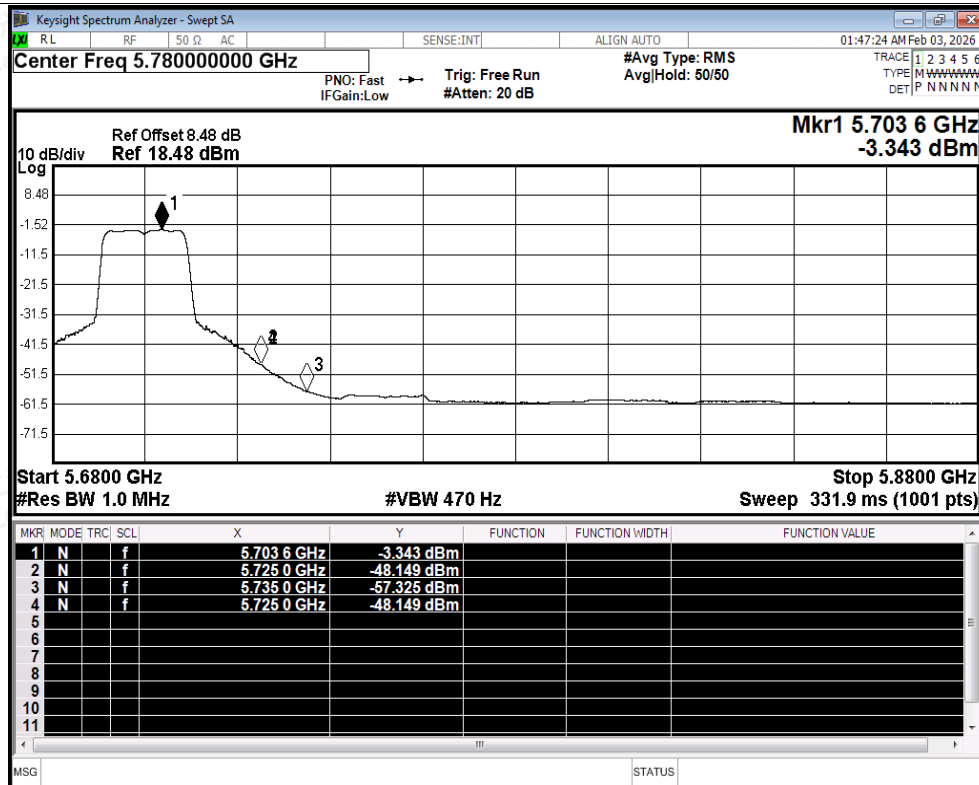

Restrict Band NVNT ac20 5700MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

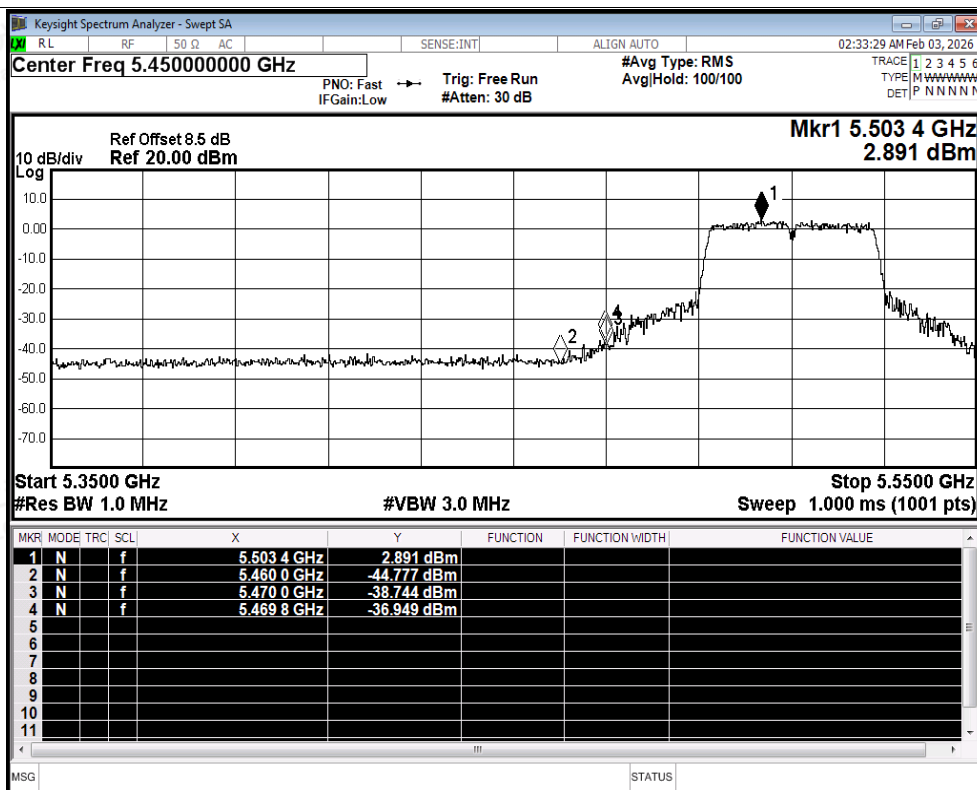

Restrict Band NVNT ac40 5510MHz Ant2 Peak

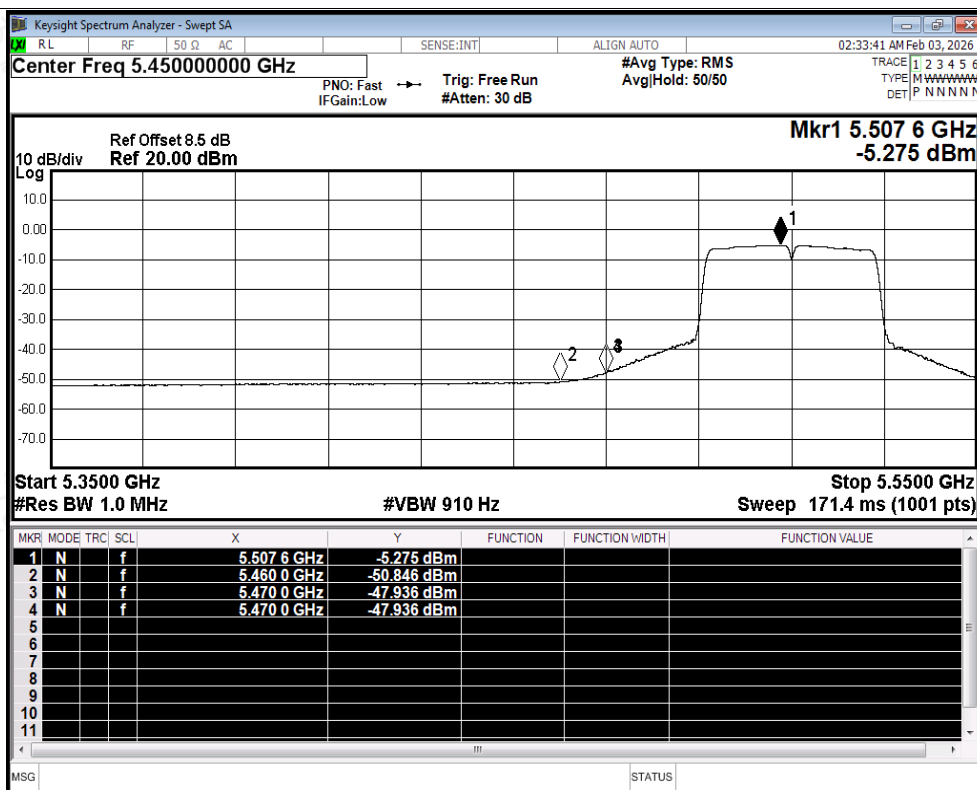

Restrict Band NVNT ac40 5510MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

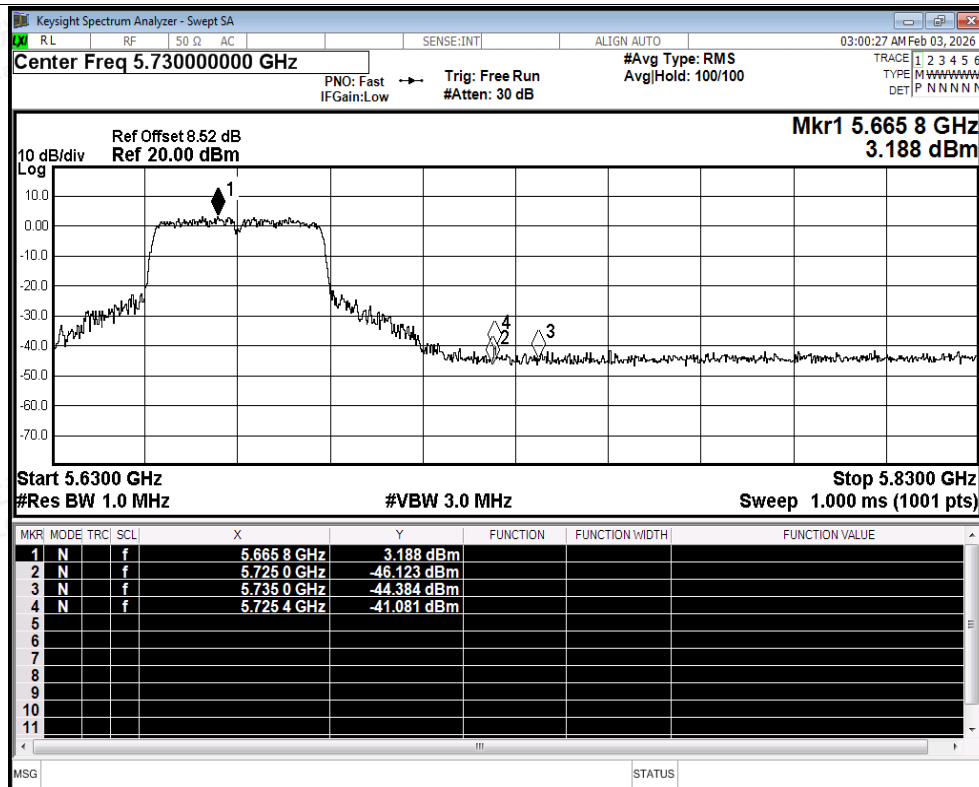

Restrict Band NVNT ac40 5670MHz Ant2 Peak

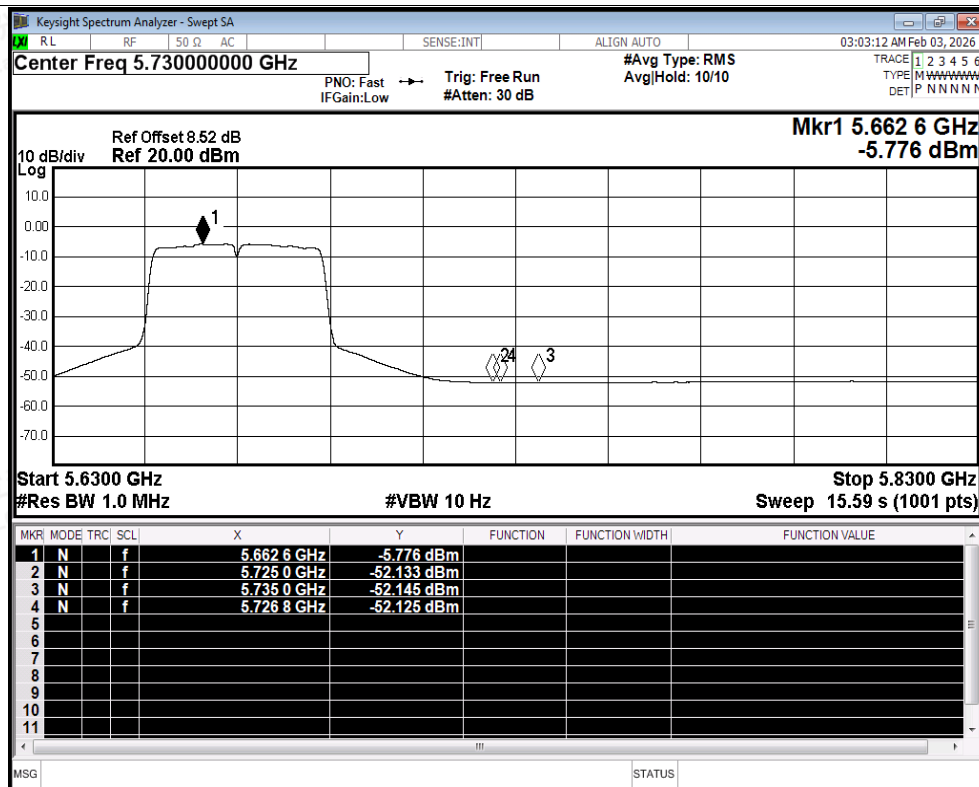

Restrict Band NVNT ac40 5670MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

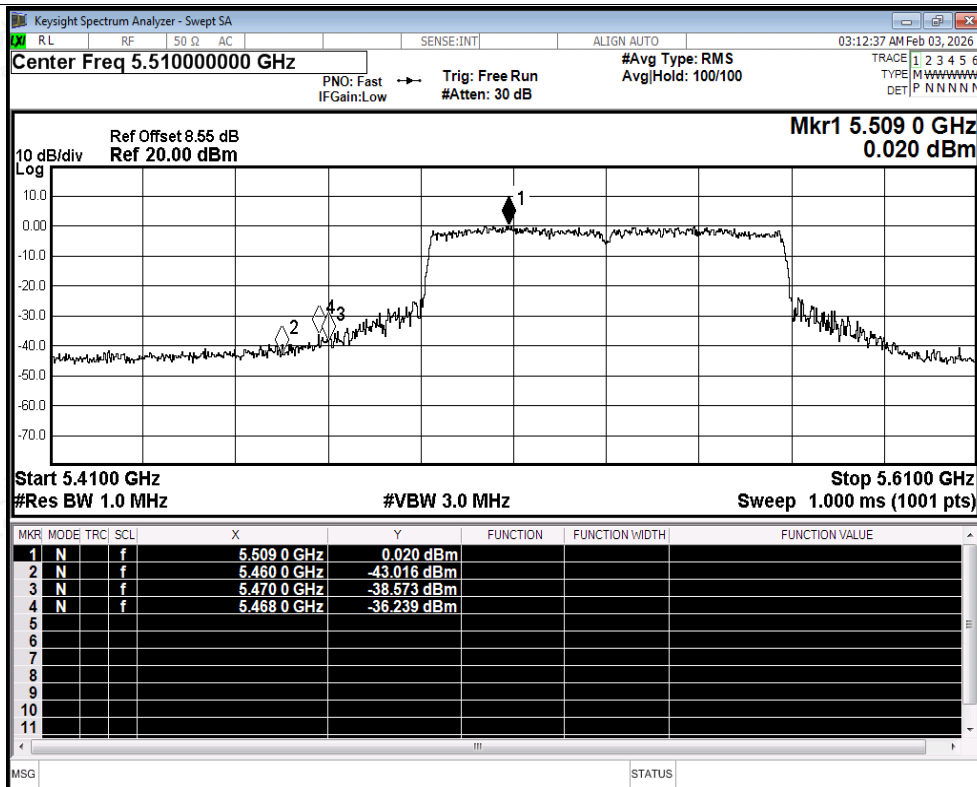

Restrict Band NVNT ac80 5530MHz Ant2 Peak

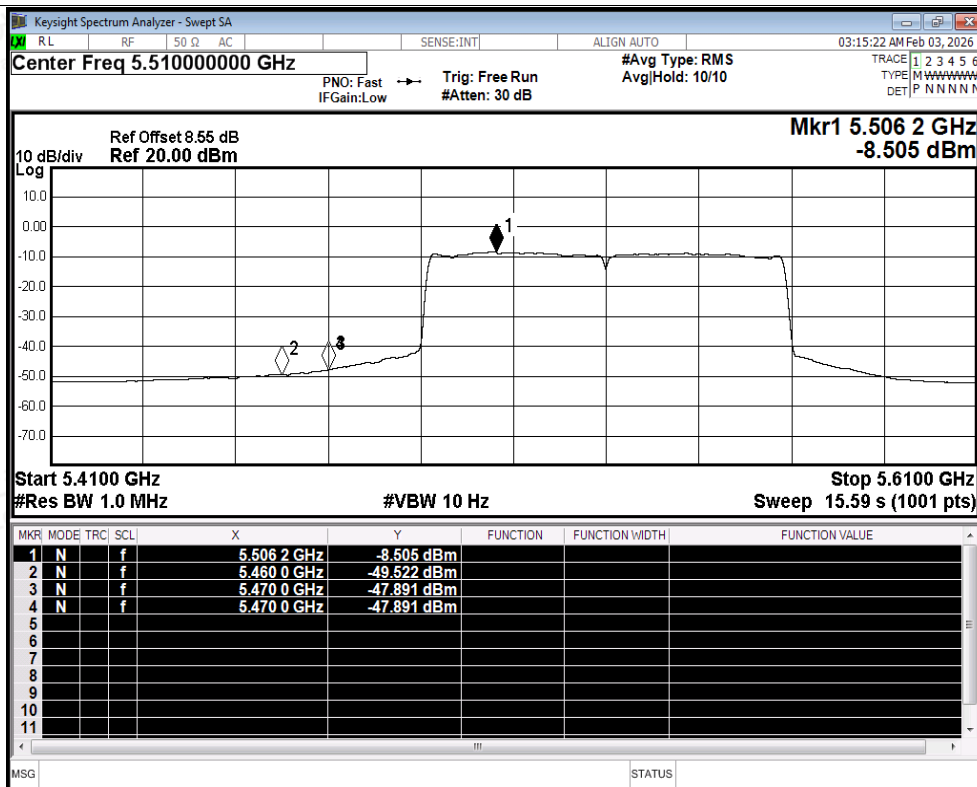

Restrict Band NVNT ac80 5530MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

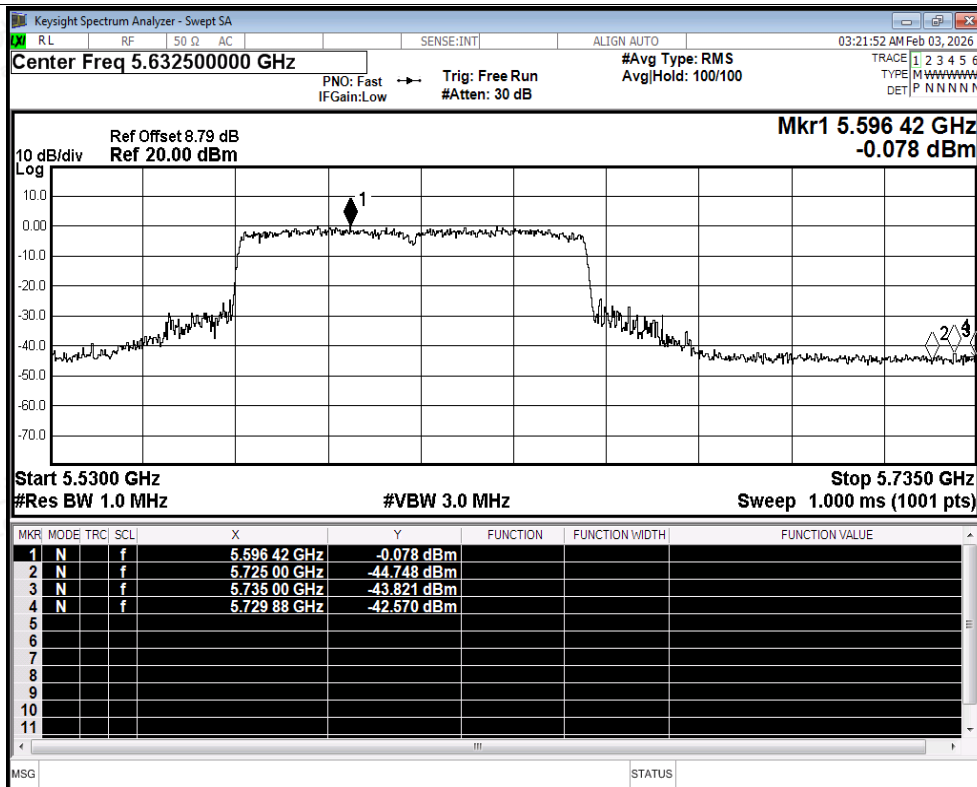

Restrict Band NVNT ac80 5610MHz Ant2 Peak

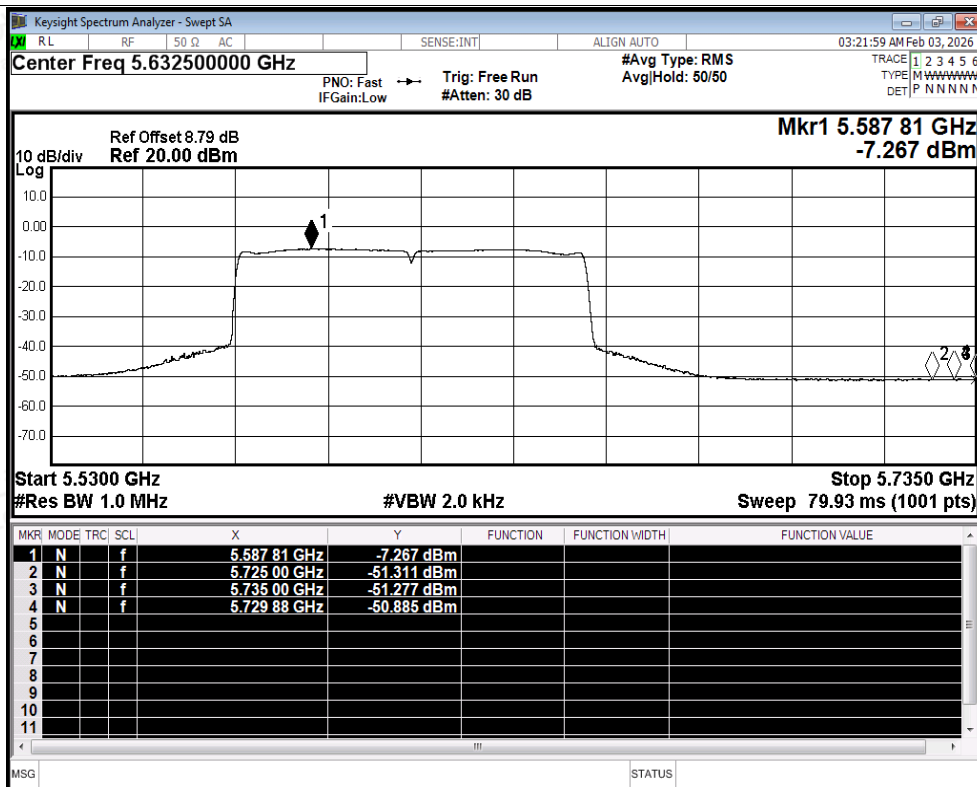

Restrict Band NVNT ac80 5610MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

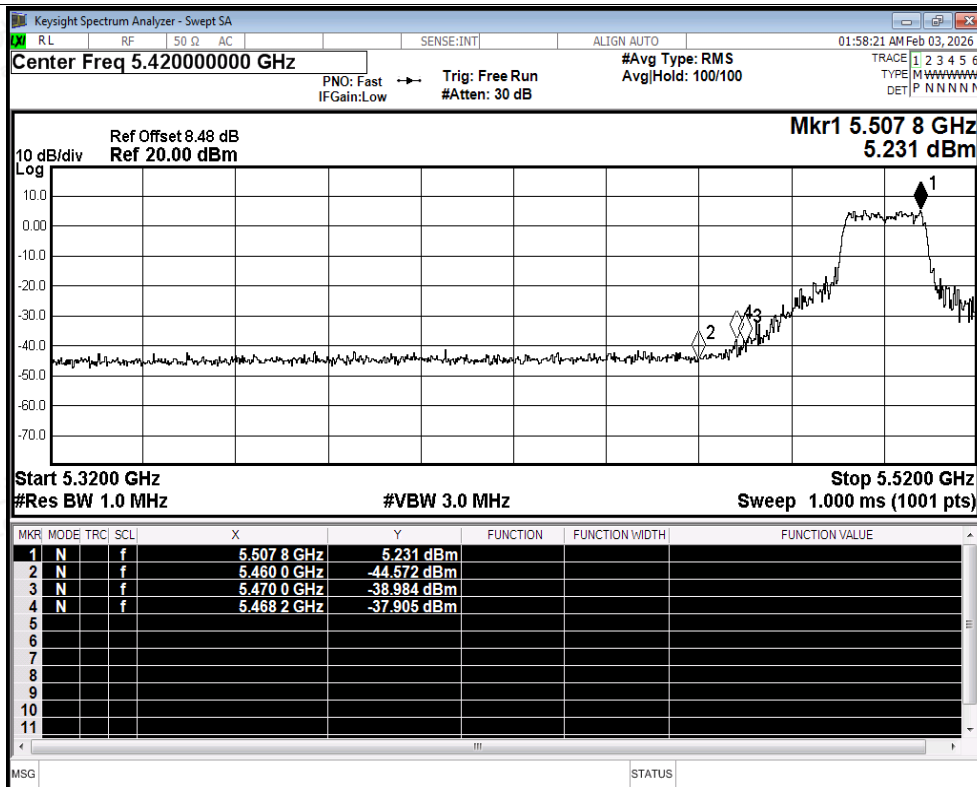

Restrict Band NVNT ax20 5500MHz Ant2 Peak

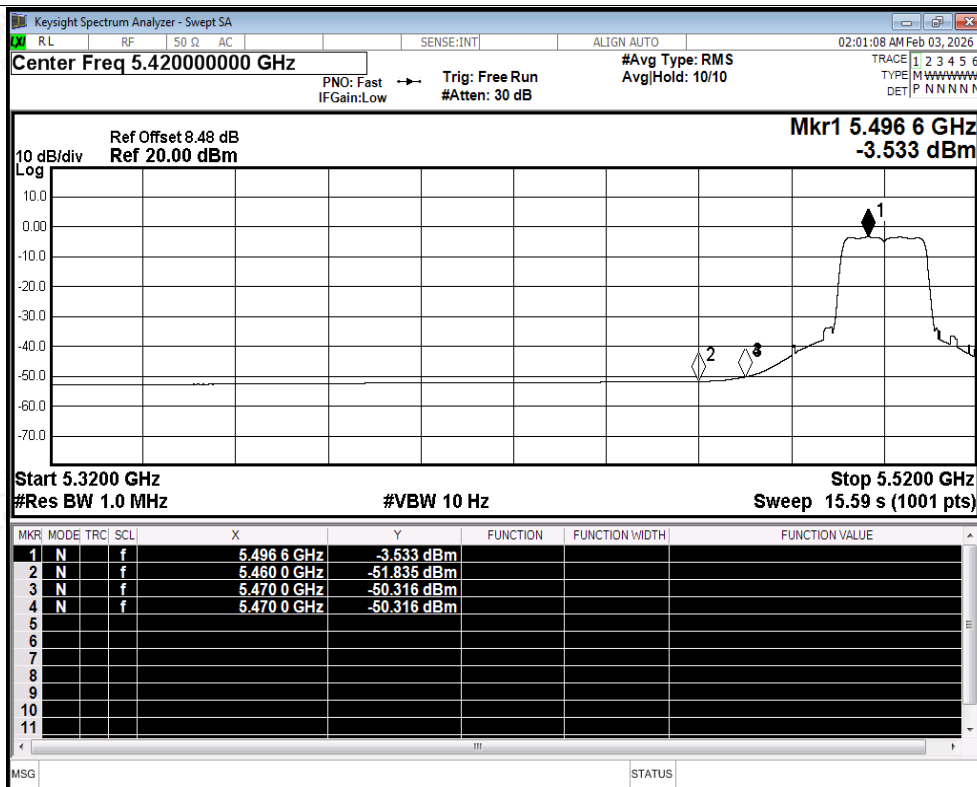

Restrict Band NVNT ax20 5500MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

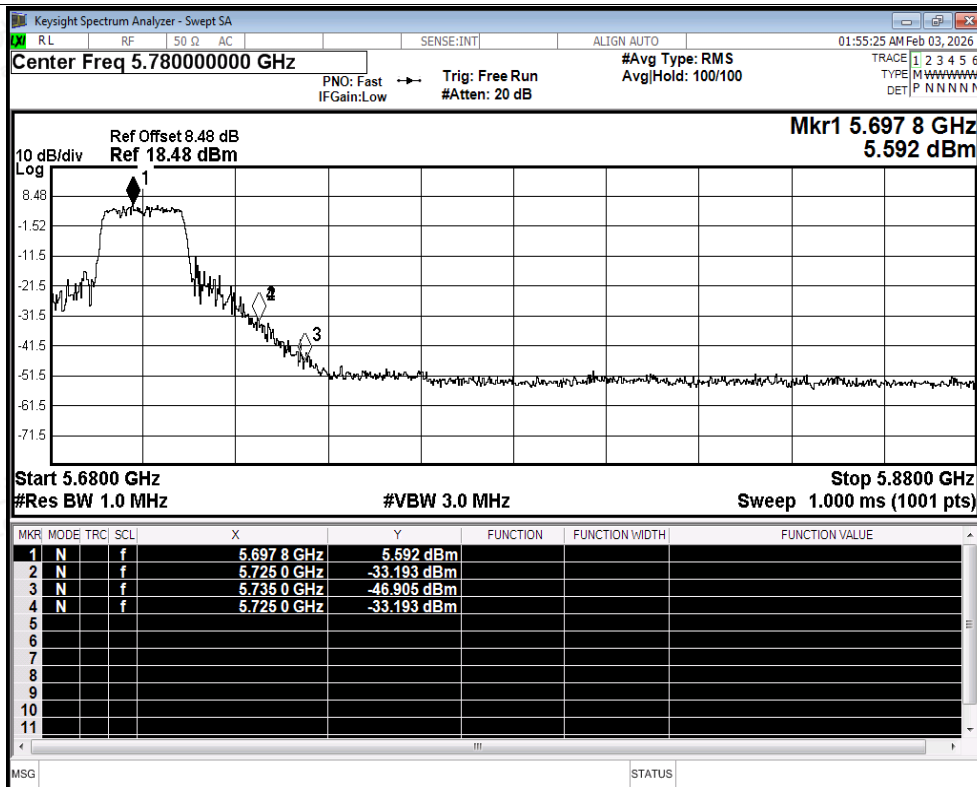

Restrict Band NVNT ax20 5700MHz Ant2 Peak

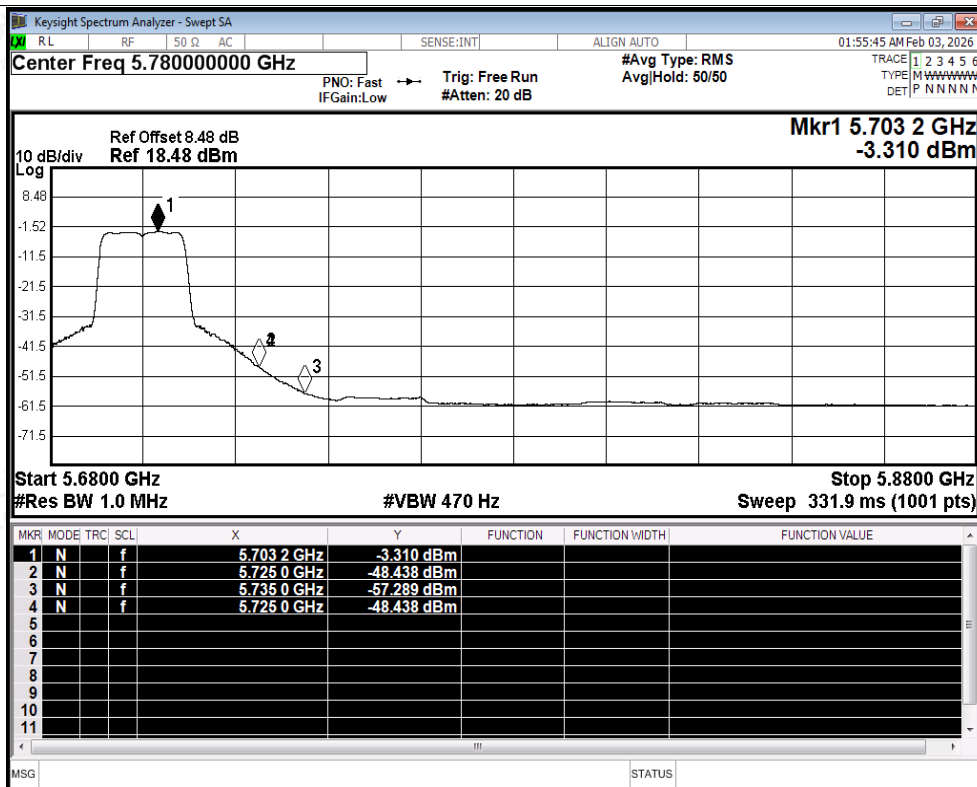

Restrict Band NVNT ax20 5700MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

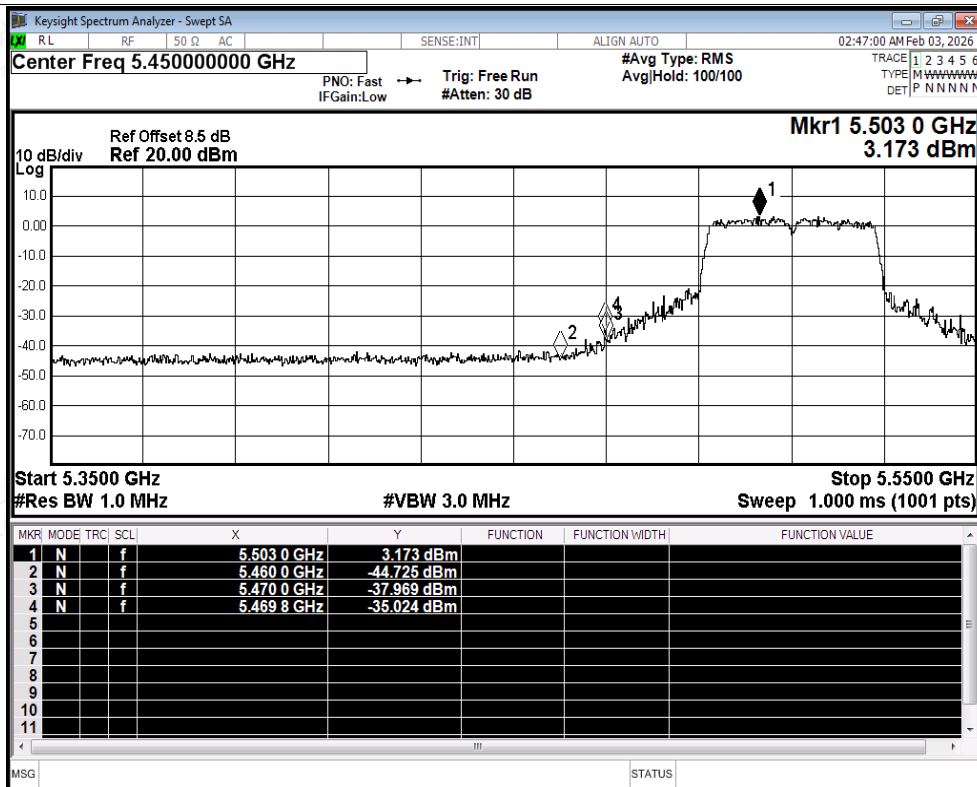

Restrict Band NVNT ax40 5510MHz Ant2 Peak

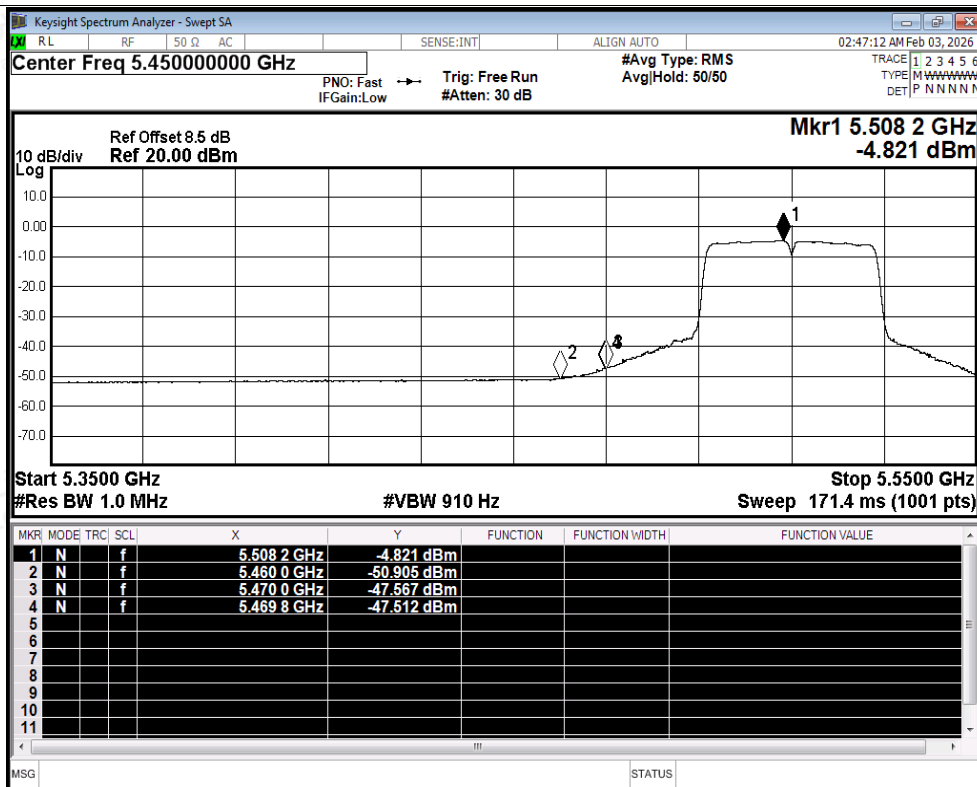

Restrict Band NVNT ax40 5510MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

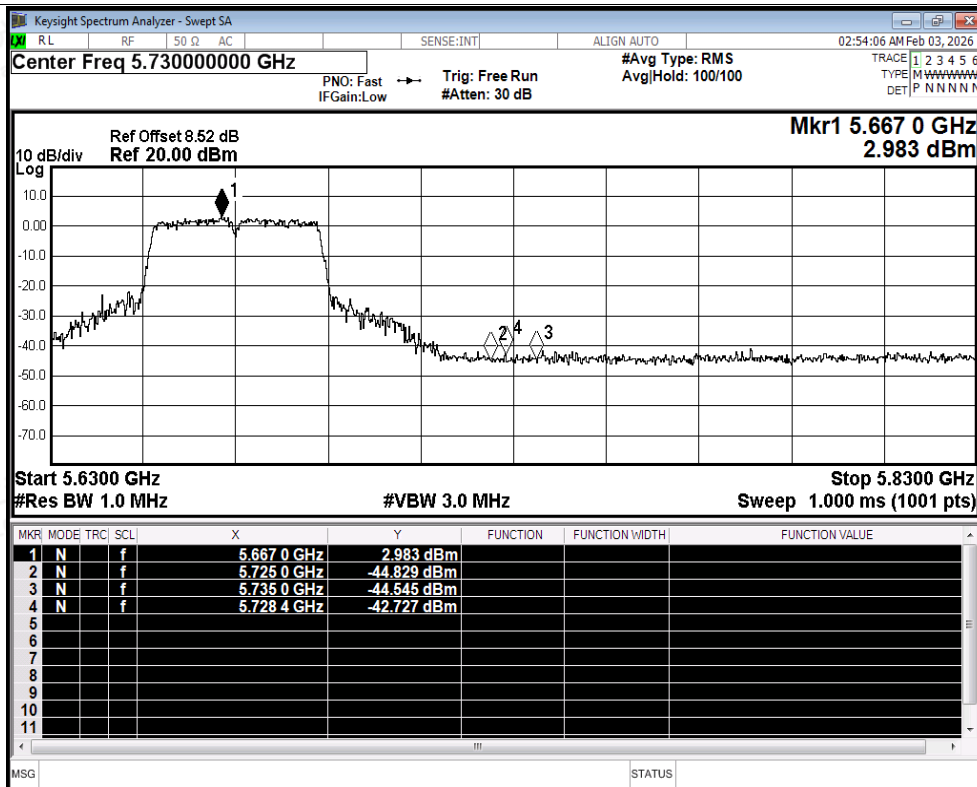

Restrict Band NVNT ax40 5670MHz Ant2 Peak

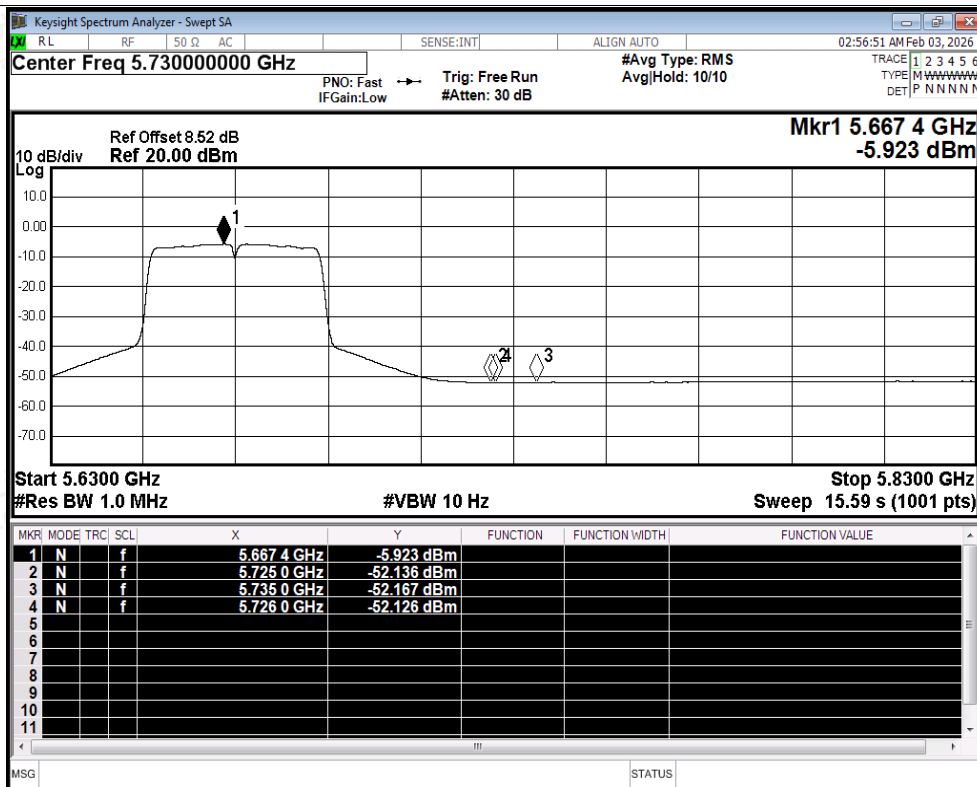

Restrict Band NVNT ax40 5670MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

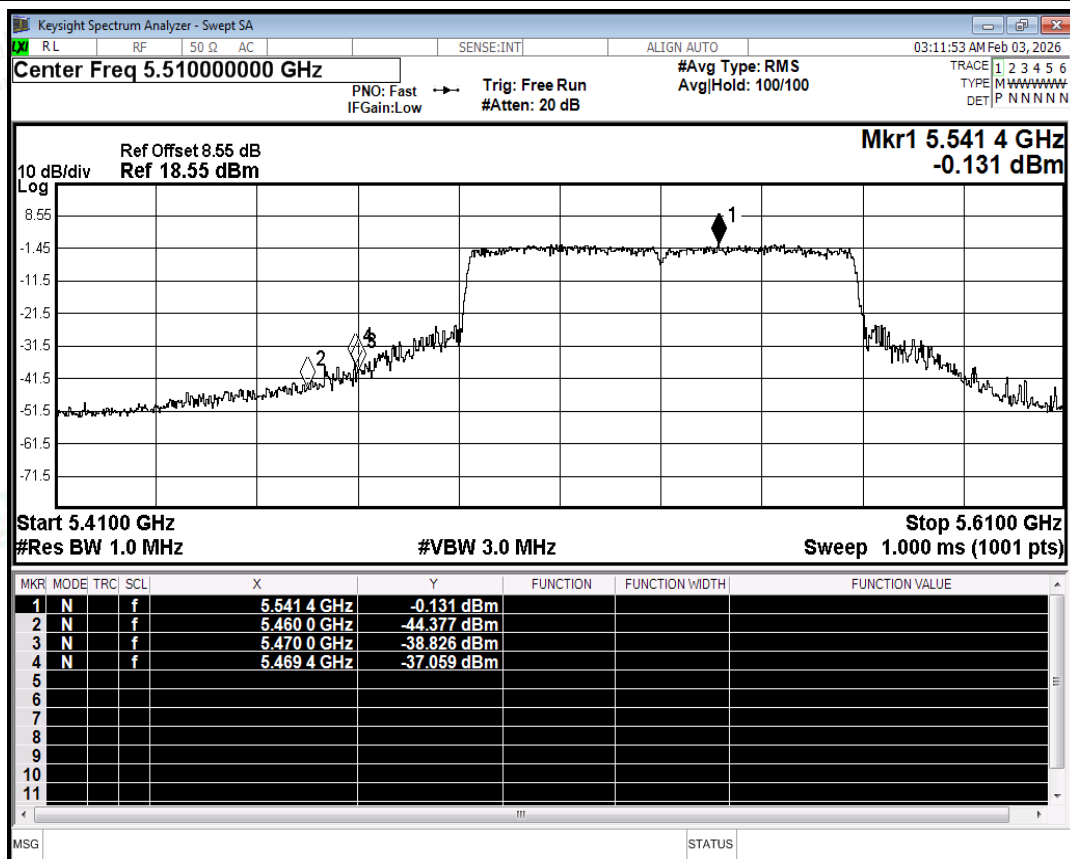

Restrict Band NVNT ax80 5530MHz Ant2 Peak

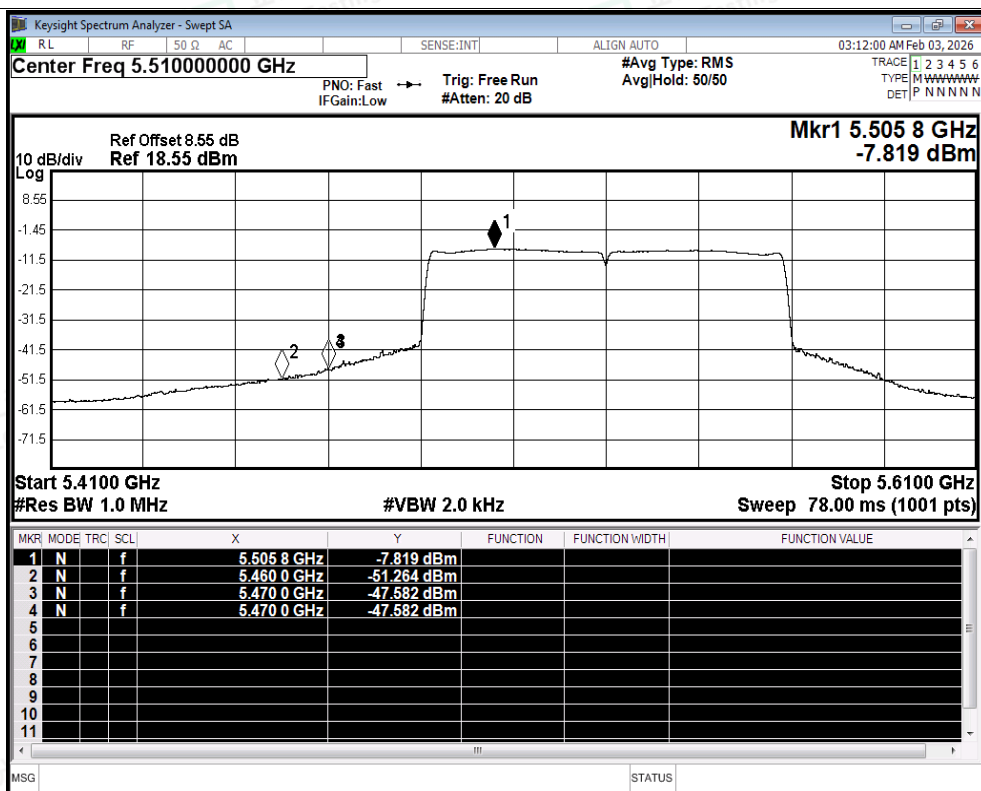

Restrict Band NVNT ax80 5530MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

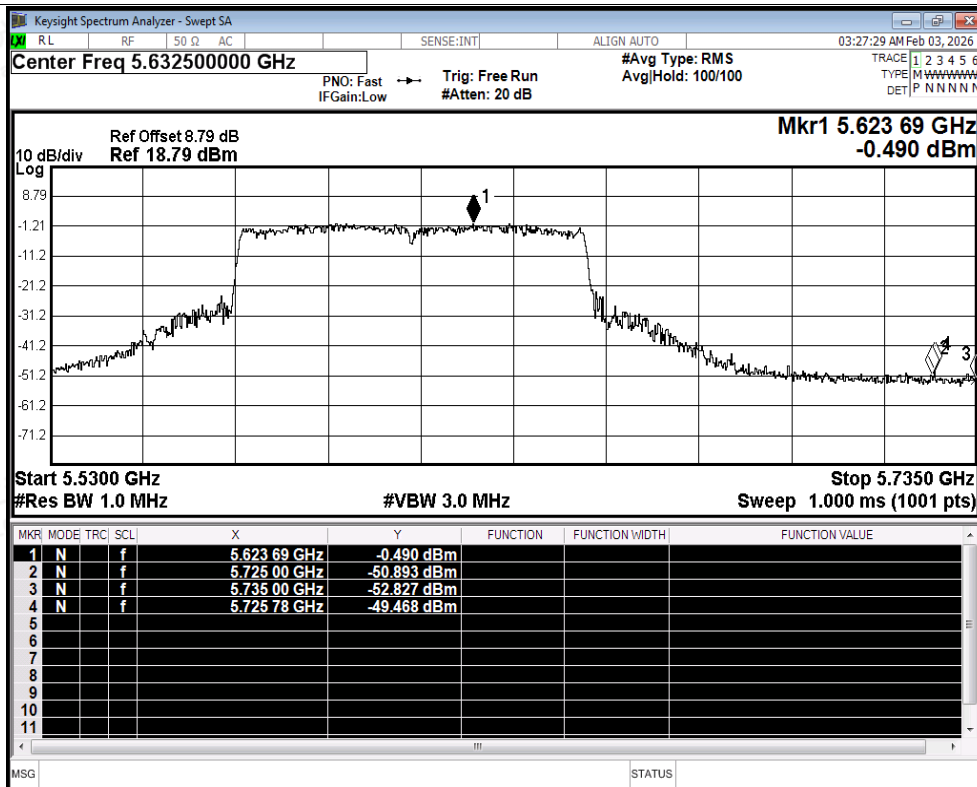

Restrict Band NVNT ax80 5610MHz Ant2 Peak

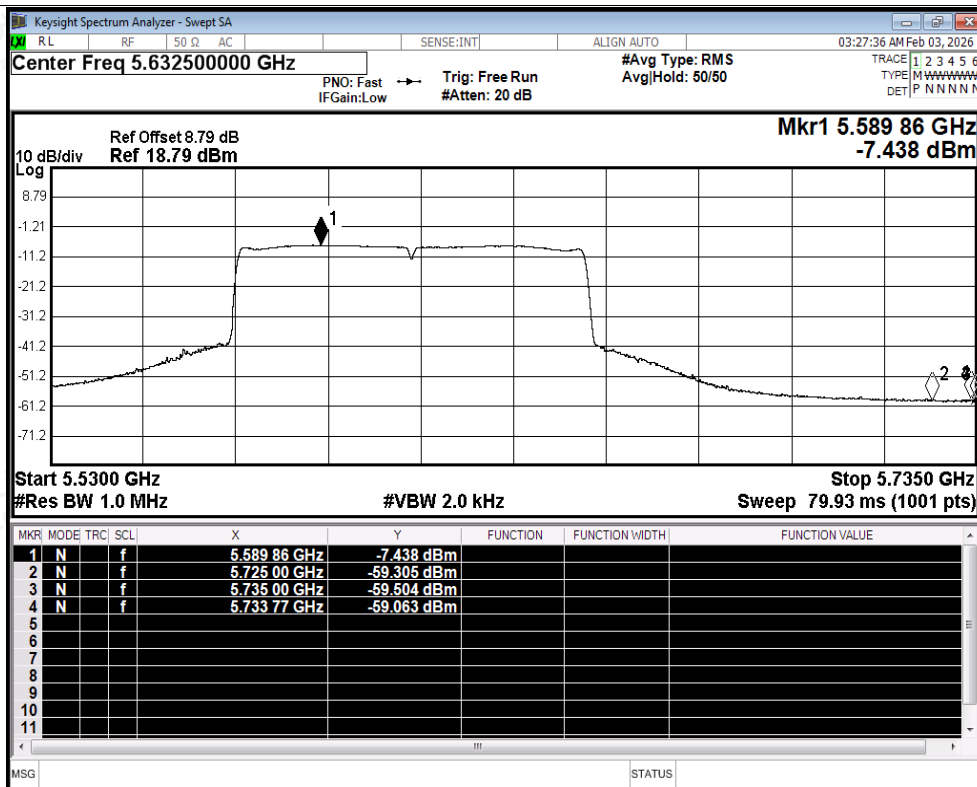

Restrict Band NVNT ax80 5610MHz Ant2 Average



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



MIMO

Condition	Mode	Frequency (MHz)	Ant1 Power (dBm)	Ant2 Power (dBm)	SUM	Gain (dBi)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	n20	5500	-56.87	-57.30	-54.07	8.59	49.75	Peak	68.2	Pass
NVNT	n20	5500	-65.32	-64.73	-62.00	8.59	41.81	Average	54	Pass
NVNT	n20	5500	-41.37	-39.81	-37.51	8.59	66.31	Peak	68.2	Pass
NVNT	n20	5500	-58.86	-60.05	-56.40	8.59	47.41	Average	54	Pass
NVNT	n20	5500	-41.30	-47.51	-40.37	8.59	63.45	Peak	68.2	Pass
NVNT	n20	5500	-59.10	-60.64	-56.79	8.59	47.03	Average	54	Pass
NVNT	n20	5700	-37.62	-42.79	-36.47	8.59	67.35	Peak	68.2	Pass
NVNT	n20	5700	-55.43	-55.27	-52.34	8.59	51.48	Average	54	Pass
NVNT	n20	5700	-47.45	-49.14	-45.20	8.59	58.61	Peak	68.2	Pass
NVNT	n20	5700	-54.46	-55.44	-51.91	8.59	51.91	Average	54	Pass
NVNT	n20	5700	-52.04	-51.23	-48.61	8.59	55.21	Peak	68.2	Pass
NVNT	n20	5700	-63.57	-64.23	-60.88	8.59	42.94	Average	54	Pass
NVNT	n40	5510	-53.75	-50.75	-48.99	8.59	54.83	Peak	68.2	Pass
NVNT	n40	5510	-64.59	-64.76	-61.66	8.59	42.15	Average	54	Pass
NVNT	n40	5510	-41.22	-41.96	-38.56	8.59	65.25	Peak	68.2	Pass
NVNT	n40	5510	-58.38	-55.86	-53.93	8.59	49.89	Average	54	Pass
NVNT	n40	5510	-46.71	-44.65	-42.55	8.59	61.27	Peak	68.2	Pass
NVNT	n40	5510	-58.46	-59.42	-55.90	8.59	47.91	Average	54	Pass
NVNT	n40	5670	-56.16	-56.57	-53.35	8.59	50.47	Peak	68.2	Pass
NVNT	n40	5670	-65.06	-65.68	-62.35	8.59	41.47	Average	54	Pass
NVNT	n40	5670	-55.42	-55.45	-52.42	8.59	51.39	Peak	68.2	Pass
NVNT	n40	5670	-64.60	-64.85	-61.71	8.59	42.10	Average	54	Pass
NVNT	n40	5670	-59.16	-58.04	-55.55	8.59	48.26	Peak	68.2	Pass
NVNT	n40	5670	-65.75	-65.78	-62.75	8.59	41.06	Average	54	Pass
NVNT	ac20	5500	-57.72	-57.56	-54.63	8.59	49.19	Peak	68.2	Pass
NVNT	ac20	5500	-65.34	-65.10	-62.21	8.59	41.61	Average	54	Pass
NVNT	ac20	5500	-44.40	-45.52	-41.91	8.59	61.90	Peak	68.2	Pass
NVNT	ac20	5500	-59.42	-60.92	-57.10	8.59	46.72	Average	54	Pass
NVNT	ac20	5500	-48.50	-48.47	-45.47	8.59	58.34	Peak	68.2	Pass
NVNT	ac20	5500	-59.56	-60.75	-57.10	8.59	46.71	Average	54	Pass
NVNT	ac20	5700	-40.71	-41.67	-38.15	8.59	65.66	Peak	68.2	Pass
NVNT	ac20	5700	-55.02	-54.92	-51.96	8.59	51.86	Average	54	Pass
NVNT	ac20	5700	-40.74	-39.35	-36.98	8.59	66.84	Peak	68.2	Pass
NVNT	ac20	5700	-54.19	-53.58	-50.86	8.59	52.95	Average	54	Pass
NVNT	ac20	5700	-52.18	-54.12	-50.03	8.59	53.79	Peak	68.2	Pass
NVNT	ac20	5700	-62.85	-63.39	-60.10	8.59	43.72	Average	54	Pass
NVNT	ac40	5510	-55.20	-56.61	-52.84	8.59	50.98	Peak	68.2	Pass
NVNT	ac40	5510	-64.26	-65.07	-61.64	8.59	42.18	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac40	5510	-42.67	-45.37	-40.80	8.59	63.01	Peak	68.2	Pass
NVNT	ac40	5510	-58.12	-58.13	-55.11	8.59	48.70	Average	54	Pass
NVNT	ac40	5510	-46.75	-46.42	-43.57	8.59	60.25	Peak	68.2	Pass
NVNT	ac40	5510	-58.95	-58.10	-55.49	8.59	48.32	Average	54	Pass
NVNT	ac40	5670	-57.38	-57.10	-54.23	8.59	49.59	Peak	68.2	Pass
NVNT	ac40	5670	-65.47	-65.03	-62.23	8.59	41.58	Average	54	Pass
NVNT	ac40	5670	-55.75	-54.84	-52.26	8.59	51.56	Peak	68.2	Pass
NVNT	ac40	5670	-64.47	-64.64	-61.54	8.59	42.27	Average	54	Pass
NVNT	ac40	5670	-57.96	-55.24	-53.38	8.59	50.44	Peak	68.2	Pass
NVNT	ac40	5670	-65.65	-66.07	-62.84	8.59	40.97	Average	54	Pass
NVNT	ac80	5530	-52.50	-51.13	-48.75	8.59	55.07	Peak	68.2	Pass
NVNT	ac80	5530	-62.04	-62.39	-59.20	8.59	44.62	Average	54	Pass
NVNT	ac80	5530	-44.14	-44.38	-41.25	8.59	62.57	Peak	68.2	Pass
NVNT	ac80	5530	-57.67	-57.72	-54.68	8.59	49.13	Average	54	Pass
NVNT	ac80	5530	-44.20	-47.41	-42.50	8.59	61.31	Peak	68.2	Pass
NVNT	ac80	5530	-59.76	-57.71	-55.60	8.59	48.21	Average	54	Pass
NVNT	ac80	5610	-48.56	-59.36	-48.21	8.59	55.60	Peak	68.2	Pass
NVNT	ac80	5610	-58.06	-66.91	-57.53	8.59	46.29	Average	54	Pass
NVNT	ac80	5610	-47.76	-56.08	-47.16	8.59	56.65	Peak	68.2	Pass
NVNT	ac80	5610	-58.29	-65.77	-57.58	8.59	46.24	Average	54	Pass
NVNT	ac80	5610	-51.67	-58.46	-50.84	8.59	52.97	Peak	68.2	Pass
NVNT	ac80	5610	-59.30	-66.10	-58.48	8.59	45.34	Average	54	Pass
NVNT	ax20	5500	-55.41	-54.36	-51.84	8.59	51.97	Peak	68.2	Pass
NVNT	ax20	5500	-64.88	-65.28	-62.07	8.59	41.75	Average	54	Pass
NVNT	ax20	5500	-42.39	-42.47	-39.42	8.59	64.40	Peak	68.2	Pass
NVNT	ax20	5500	-59.70	-59.03	-56.34	8.59	47.48	Average	54	Pass
NVNT	ax20	5500	-42.39	-45.00	-40.49	8.59	63.33	Peak	68.2	Pass
NVNT	ax20	5500	-59.63	-60.71	-57.13	8.59	46.69	Average	54	Pass
NVNT	ax20	5700	-39.71	-39.51	-36.60	8.59	67.22	Peak	68.2	Pass
NVNT	ax20	5700	-55.62	-56.54	-53.05	8.59	50.77	Average	54	Pass
NVNT	ax20	5700	-47.62	-49.25	-45.35	8.59	58.47	Peak	68.2	Pass
NVNT	ax20	5700	-56.84	-56.87	-53.84	8.59	49.97	Average	54	Pass
NVNT	ax20	5700	-48.85	-48.27	-45.54	8.59	58.28	Peak	68.2	Pass
NVNT	ax20	5700	-57.93	-57.46	-54.68	8.59	49.14	Average	54	Pass
NVNT	ax40	5510	-55.63	-55.75	-52.68	8.59	51.14	Peak	68.2	Pass
NVNT	ax40	5510	-64.90	-64.72	-61.80	8.59	42.02	Average	54	Pass
NVNT	ax40	5510	-41.86	-43.25	-39.49	8.59	64.33	Peak	68.2	Pass
NVNT	ax40	5510	-58.62	-58.35	-55.47	8.59	48.34	Average	54	Pass
NVNT	ax40	5510	-42.46	-43.29	-39.84	8.59	63.97	Peak	68.2	Pass
NVNT	ax40	5510	-58.46	-58.54	-55.49	8.59	48.33	Average	54	Pass
NVNT	ax40	5670	-55.87	-57.16	-53.46	8.59	50.36	Peak	68.2	Pass
NVNT	ax40	5670	-65.63	-65.39	-62.50	8.59	41.32	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax40	5670	-55.73	-55.00	-52.34	8.59	51.48	Peak	68.2	Pass
NVNT	ax40	5670	-64.79	-64.92	-61.84	8.59	41.97	Average	54	Pass
NVNT	ax40	5670	-57.56	-57.15	-54.34	8.59	49.48	Peak	68.2	Pass
NVNT	ax40	5670	-66.24	-66.03	-63.12	8.59	40.69	Average	54	Pass
NVNT	ax80	5530	-50.54	-54.20	-48.99	8.59	54.83	Peak	68.2	Pass
NVNT	ax80	5530	-62.78	-62.30	-59.52	8.59	44.29	Average	54	Pass
NVNT	ax80	5530	-43.05	-44.50	-40.70	8.59	63.11	Peak	68.2	Pass
NVNT	ax80	5530	-58.49	-57.77	-55.10	8.59	48.71	Average	54	Pass
NVNT	ax80	5530	-45.21	-47.52	-43.20	8.59	60.61	Peak	68.2	Pass
NVNT	ax80	5530	-58.65	-59.56	-56.07	8.59	47.75	Average	54	Pass
NVNT	ax80	5610	-48.58	-59.18	-48.22	8.59	55.60	Peak	68.2	Pass
NVNT	ax80	5610	-58.13	-66.51	-57.54	8.59	46.28	Average	54	Pass
NVNT	ax80	5610	-48.46	-56.33	-47.80	8.59	56.01	Peak	68.2	Pass
NVNT	ax80	5610	-58.02	-65.81	-57.35	8.59	46.47	Average	54	Pass
NVNT	ax80	5610	-52.32	-59.79	-51.60	8.59	52.21	Peak	68.2	Pass
NVNT	ax80	5610	-58.84	-66.92	-58.21	8.59	45.61	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



F.5 Frequency Stability

Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5500	Ant1	5499.98	-20000	-3.64	25	Pass
NVNT	a	5580	Ant1	5579.98	-20000	-3.58	25	Pass
NVNT	a	5700	Ant1	5699.98	-20000	-3.51	25	Pass
NVNT	n20	5500	Ant1	5499.98	-20000	-3.64	25	Pass
NVNT	n20	5580	Ant1	5579.98	-20000	-3.58	25	Pass
NVNT	n20	5700	Ant1	5699.98	-20000	-3.51	25	Pass
NVNT	n40	5510	Ant1	5509.96	-40000	-7.26	25	Pass
NVNT	n40	5550	Ant1	5550	0	0	25	Pass
NVNT	n40	5670	Ant1	5670	0	0	25	Pass
NVNT	ac20	5500	Ant1	5499.98	-20000	-3.64	25	Pass
NVNT	ac20	5580	Ant1	5579.96	-40000	-7.17	25	Pass
NVNT	ac20	5700	Ant1	5699.98	-20000	-3.51	25	Pass
NVNT	ac40	5510	Ant1	5510	0	0	25	Pass
NVNT	ac40	5550	Ant1	5550	0	0	25	Pass
NVNT	ac40	5670	Ant1	5670	0	0	25	Pass
NVNT	ac80	5530	Ant1	5530	0	0	25	Pass
NVNT	ac80	5610	Ant1	5610	0	0	25	Pass
NVNT	ax20	5500	Ant1	5499.98	-20000	-3.64	25	Pass
NVNT	ax20	5580	Ant1	5579.98	-20000	-3.58	25	Pass
NVNT	ax20	5700	Ant1	5699.98	-20000	-3.51	25	Pass
NVNT	ax40	5510	Ant1	5510	0	0	25	Pass
NVNT	ax40	5550	Ant1	5550	0	0	25	Pass
NVNT	ax40	5670	Ant1	5670	0	0	25	Pass
NVNT	ax80	5530	Ant1	5530	0	0	25	Pass
NVNT	ax80	5610	Ant1	5610	0	0	25	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

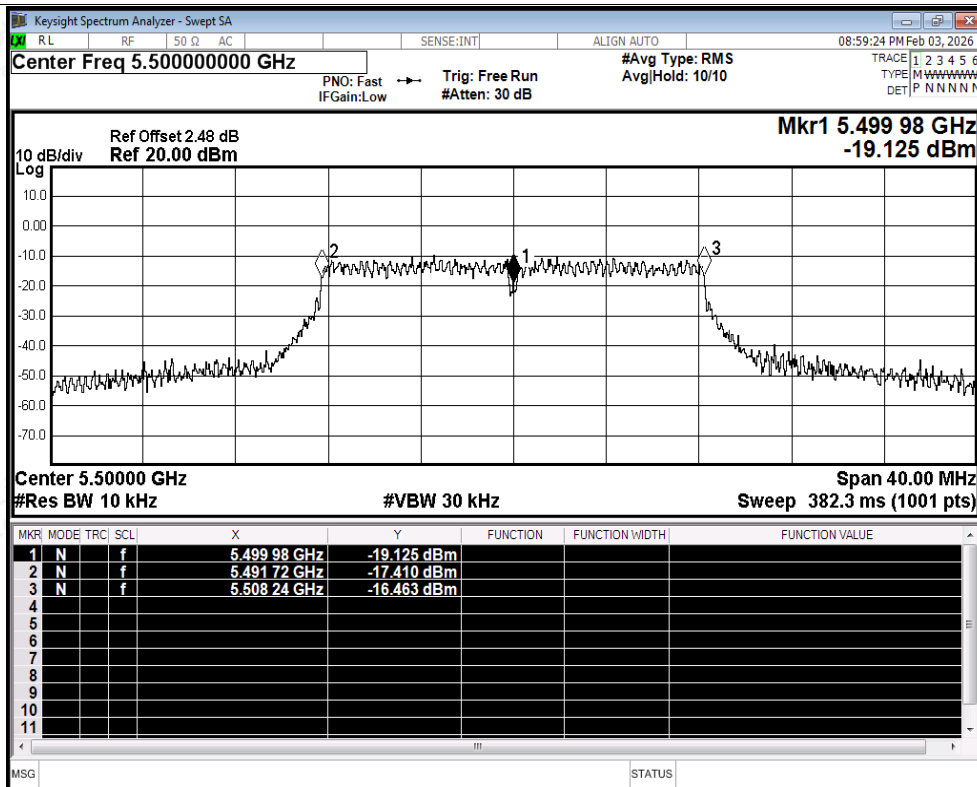

Freq. Stability NVNT a 5500MHz Ant1

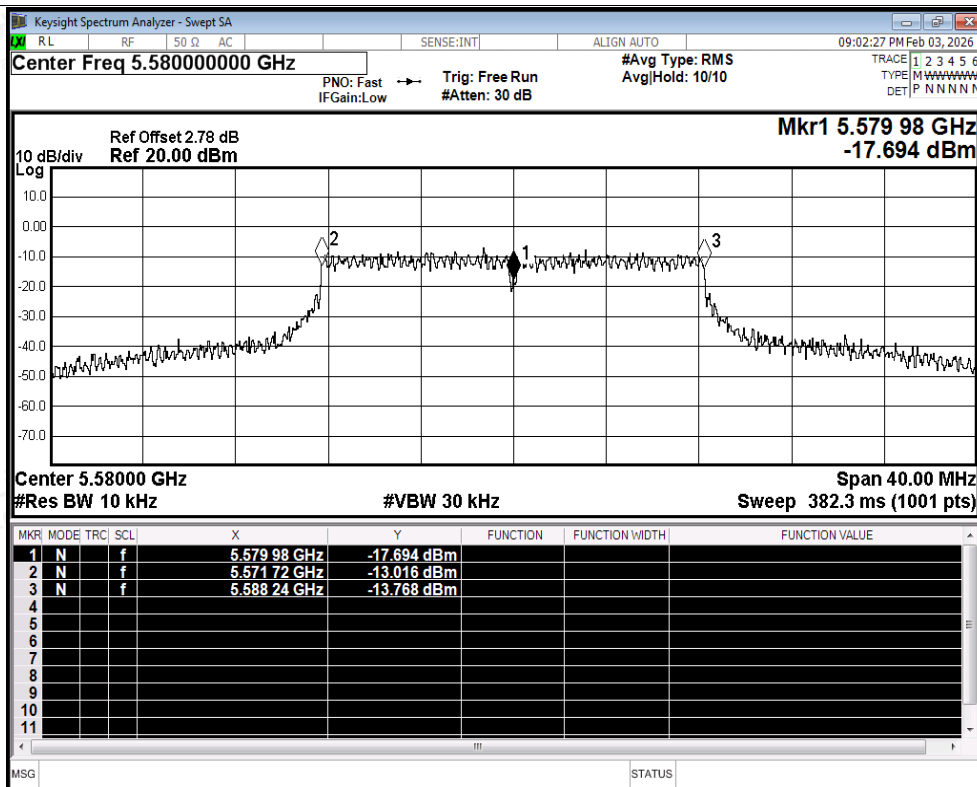

Freq. Stability NVNT a 5580MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

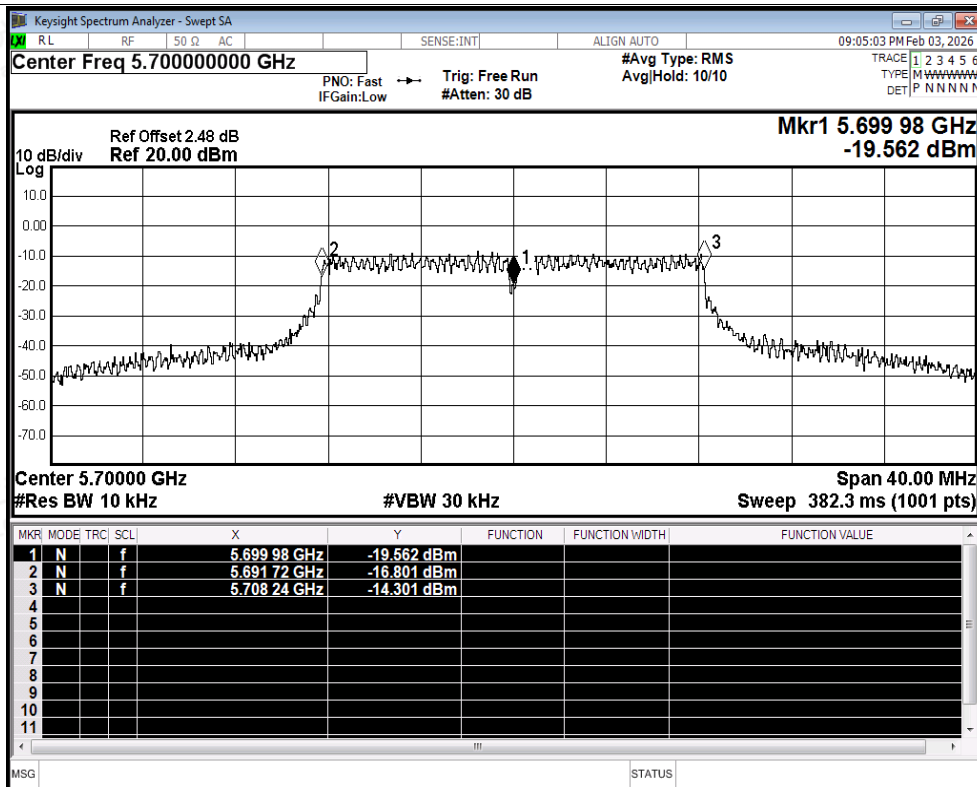

Freq. Stability NVNT a 5700MHz Ant1

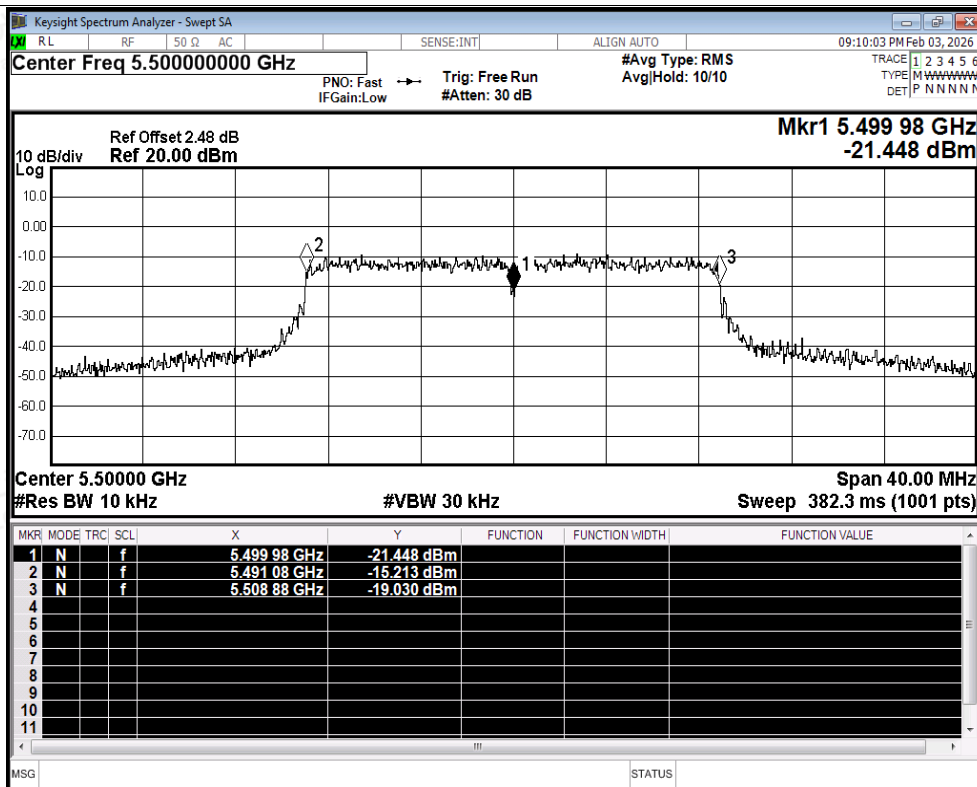

Freq. Stability NVNT n20 5500MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

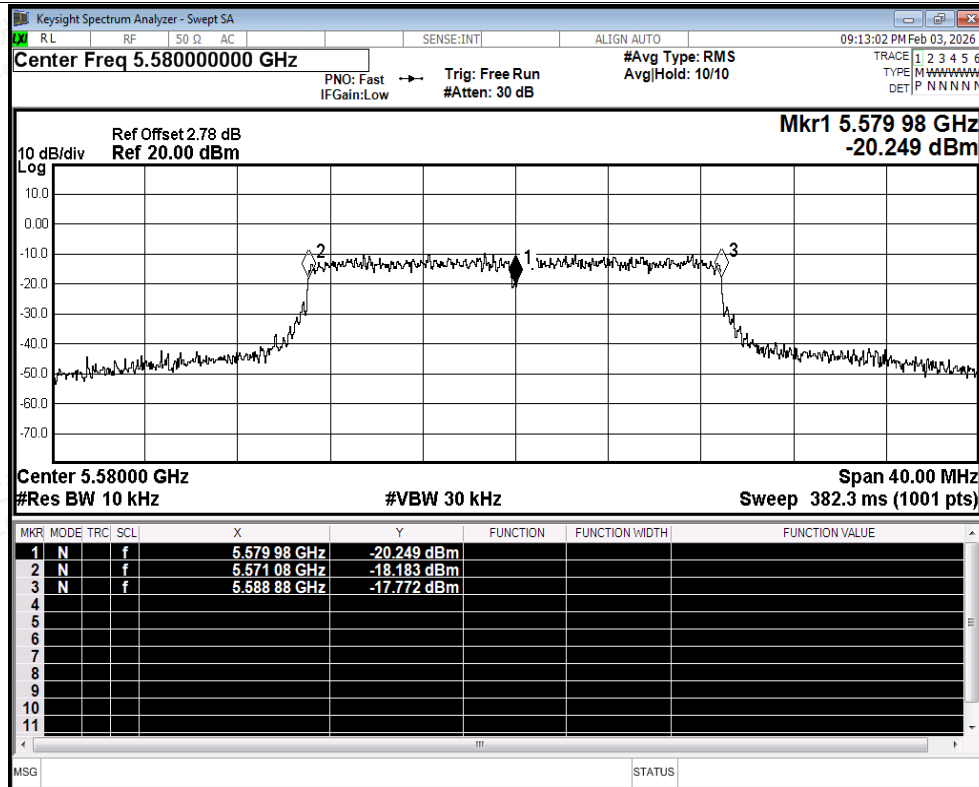

Freq. Stability NVNT n20 5580MHz Ant1

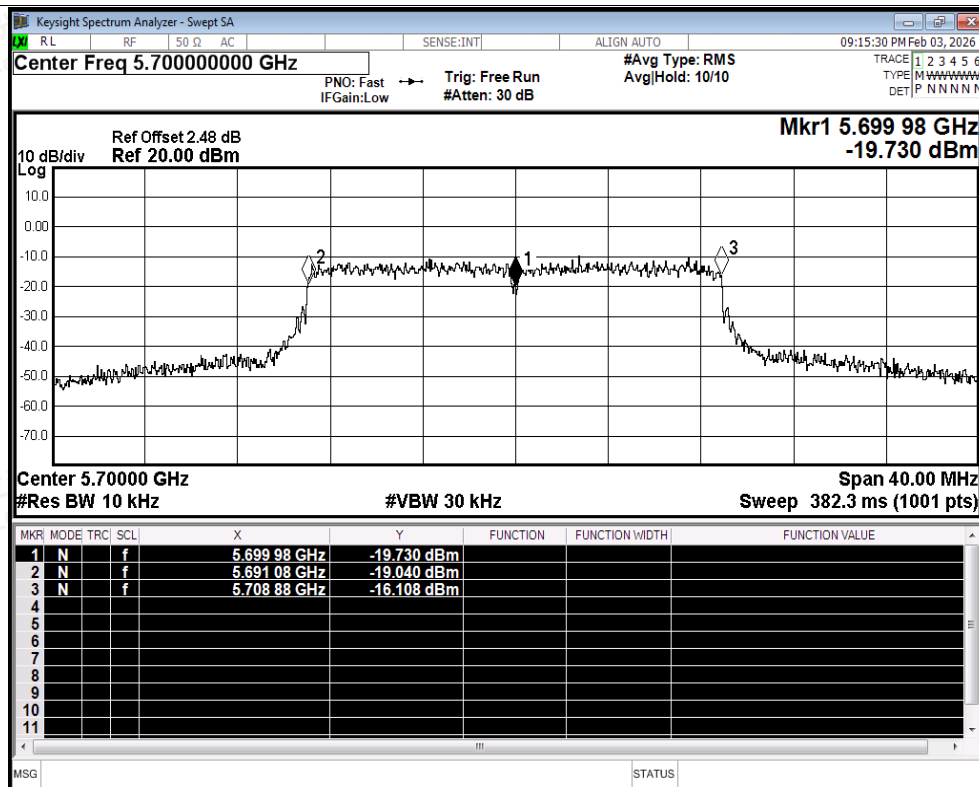

Freq. Stability NVNT n20 5700MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

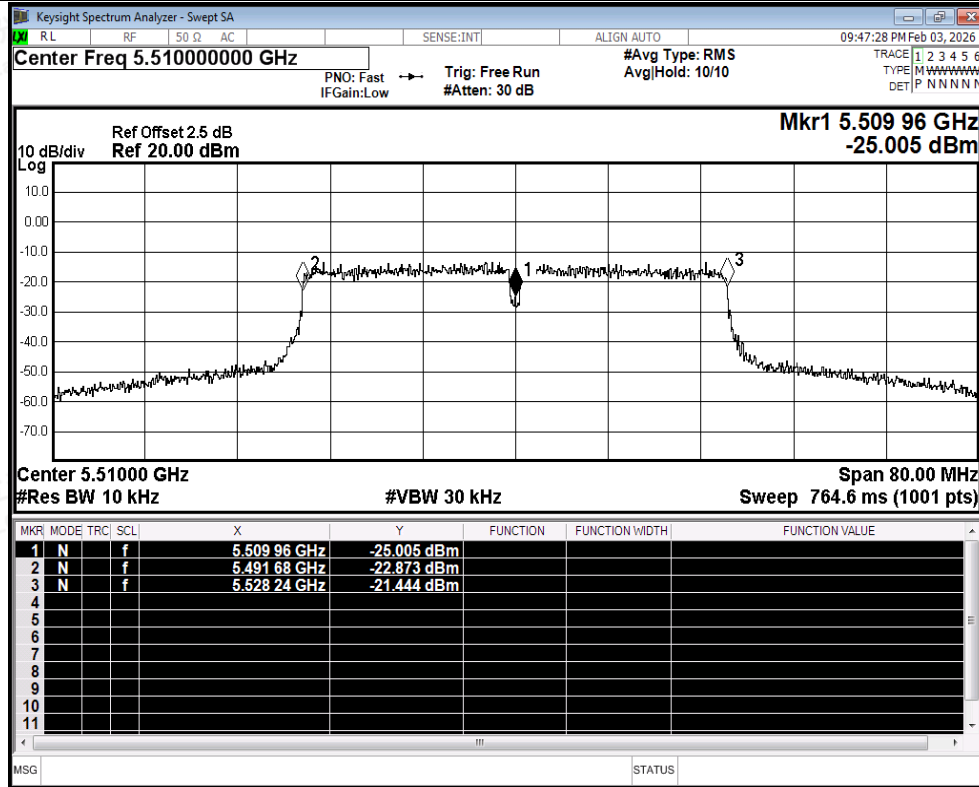

Freq. Stability NVNT n40 5510MHz Ant1

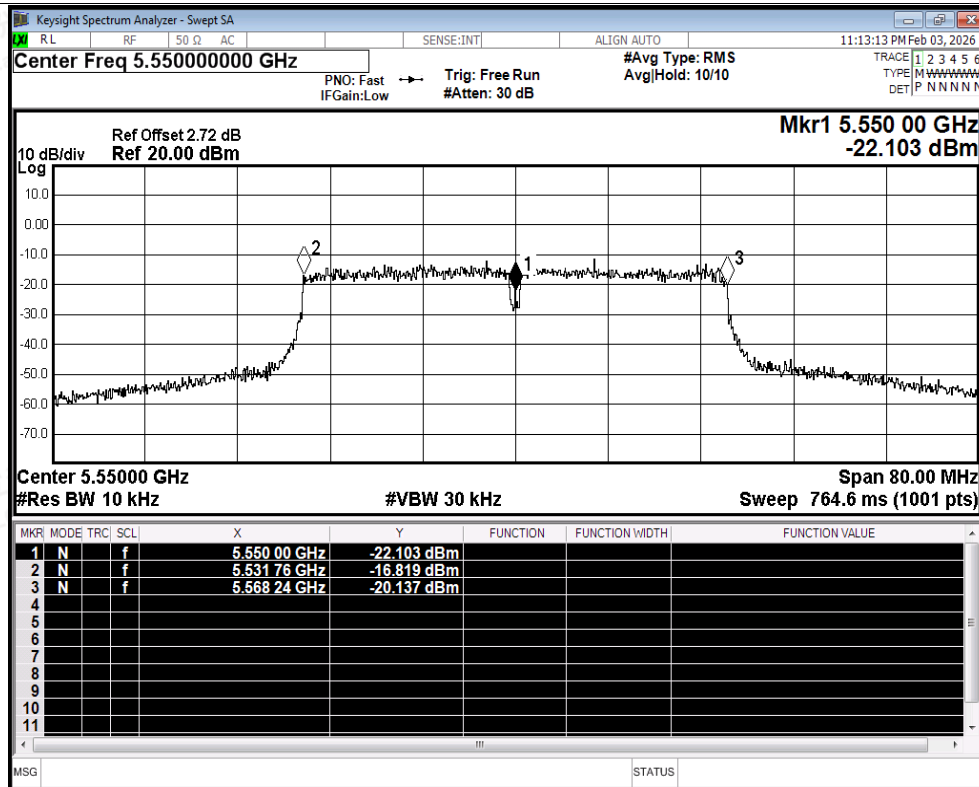

Freq. Stability NVNT n40 5550MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

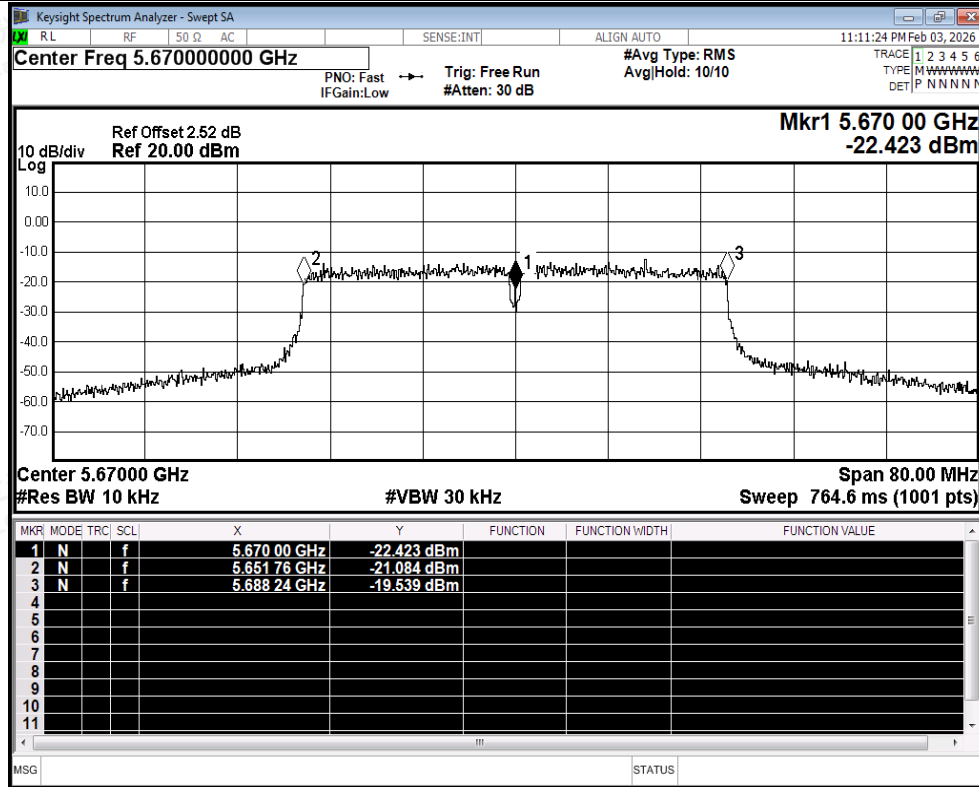

Freq. Stability NVNT n40 5670MHz Ant1

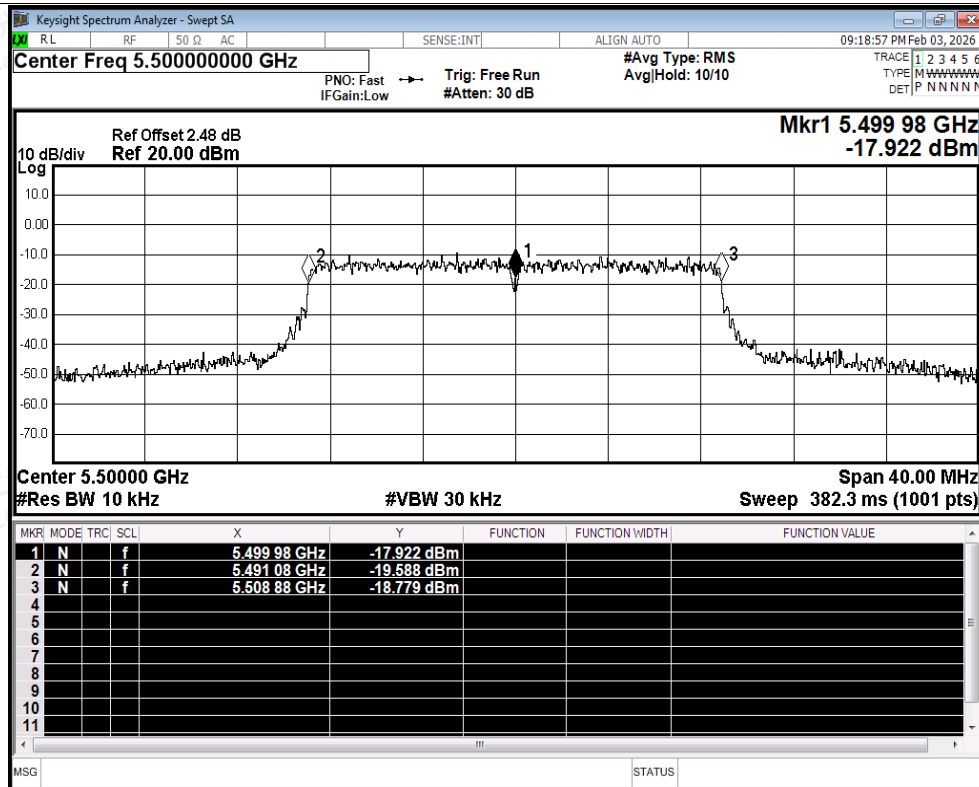

Freq. Stability NVNT ac20 5500MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

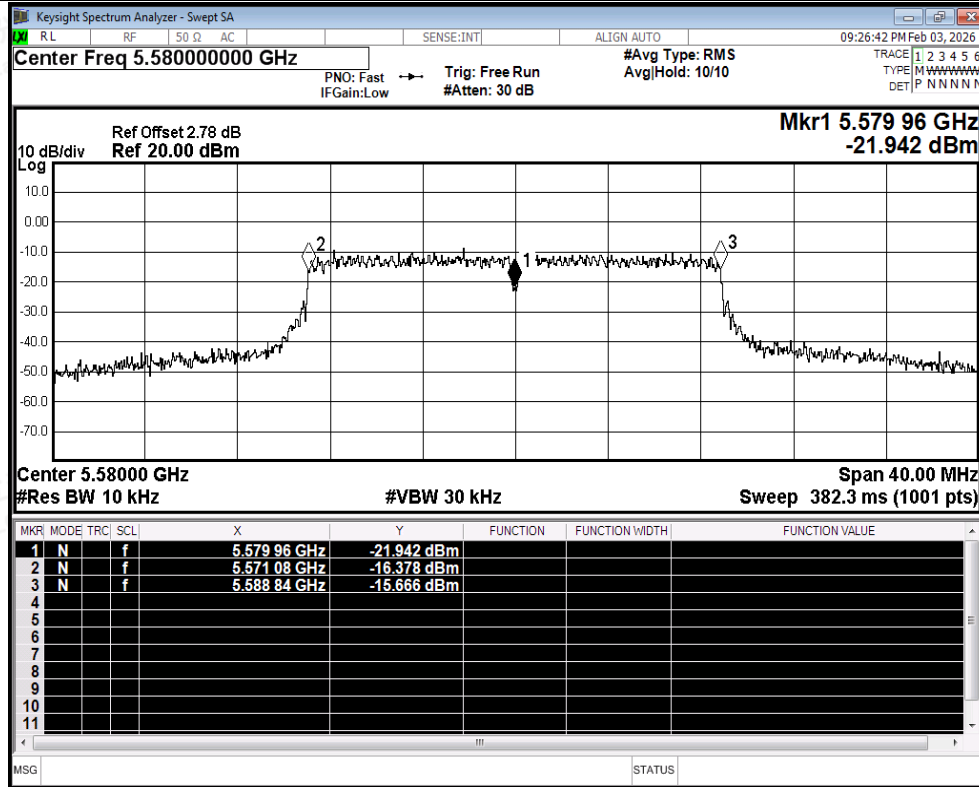

Freq. Stability NVNT ac20 5580MHz Ant1

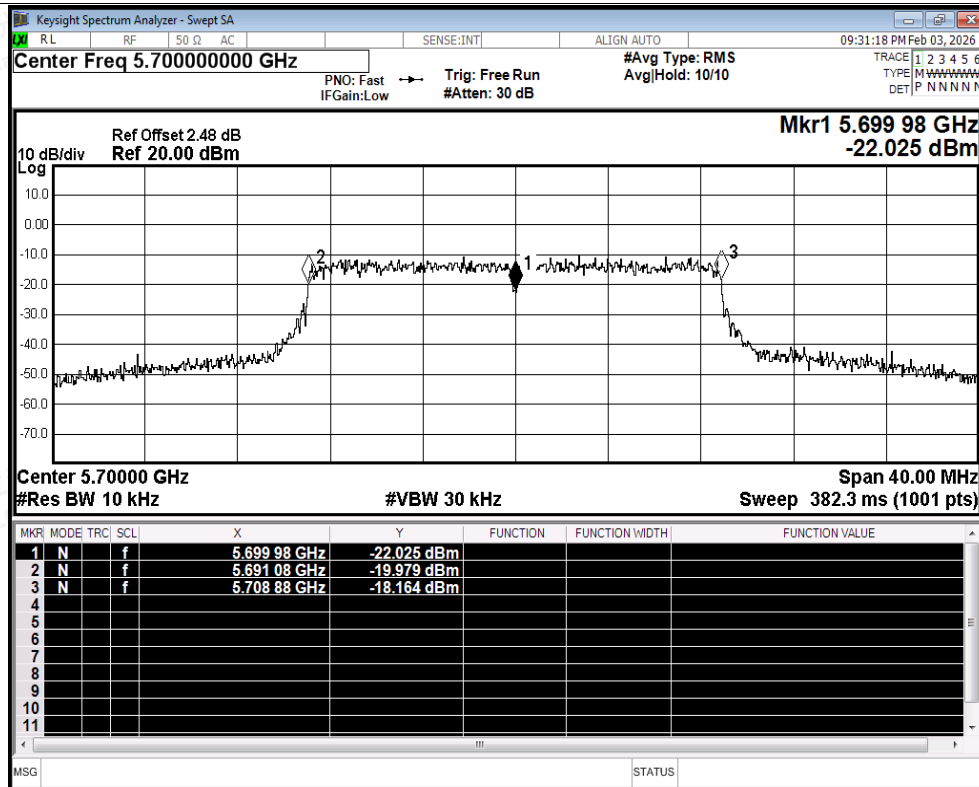

Freq. Stability NVNT ac20 5700MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

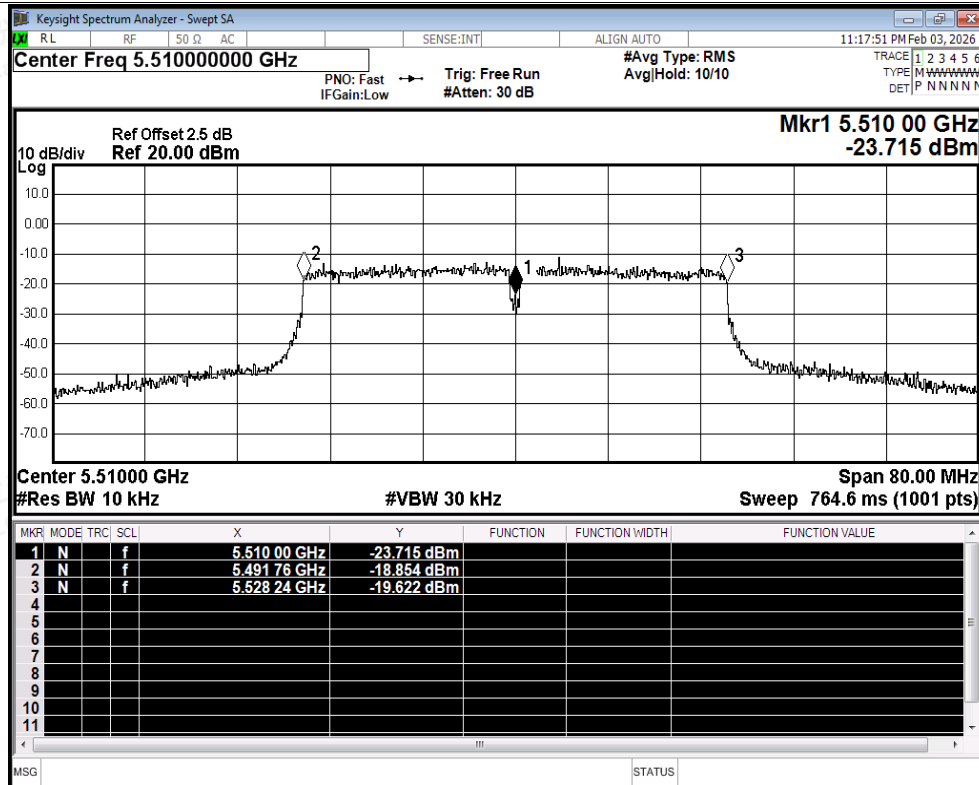

Freq. Stability NVNT ac40 5510MHz Ant1

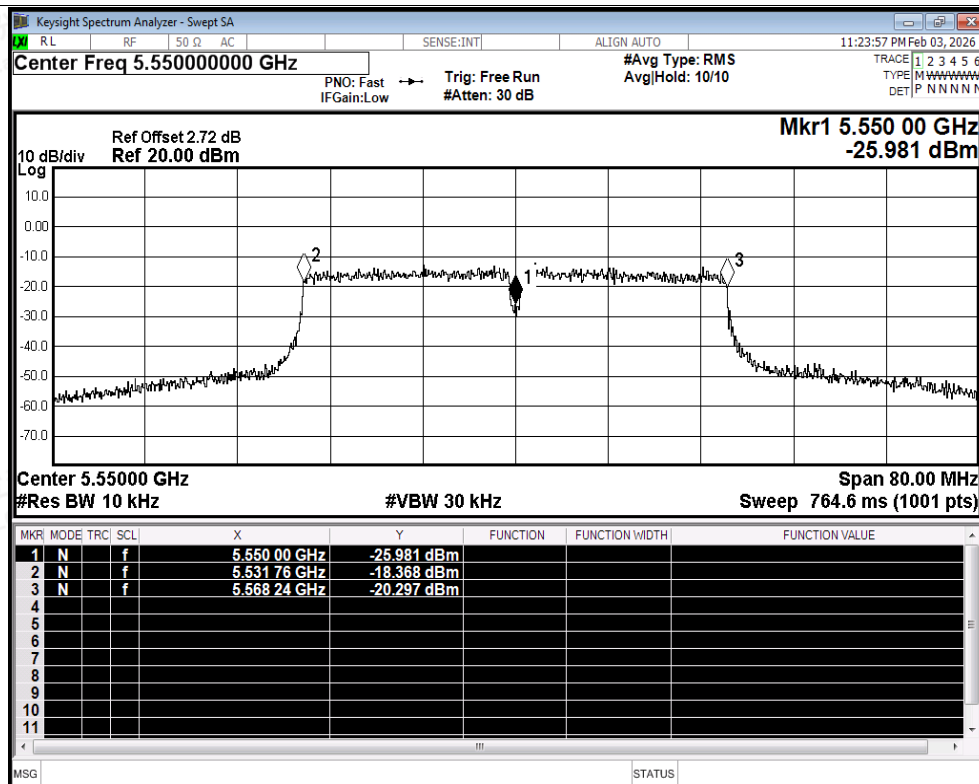

Freq. Stability NVNT ac40 5550MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

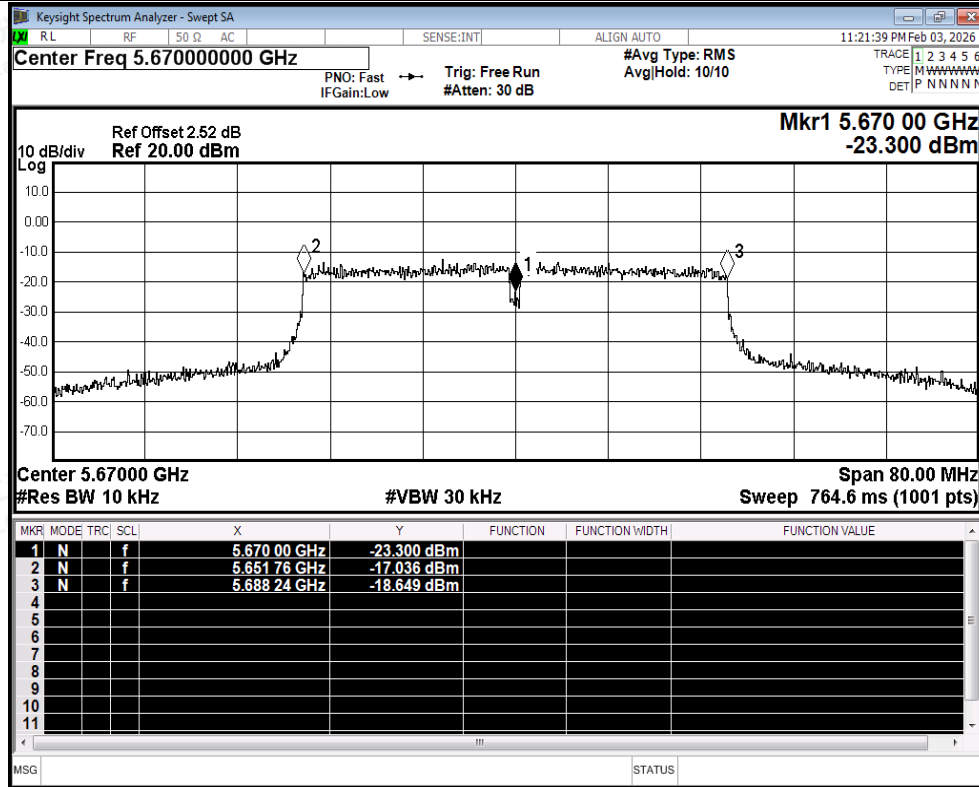

Freq. Stability NVNT ac40 5670MHz Ant1

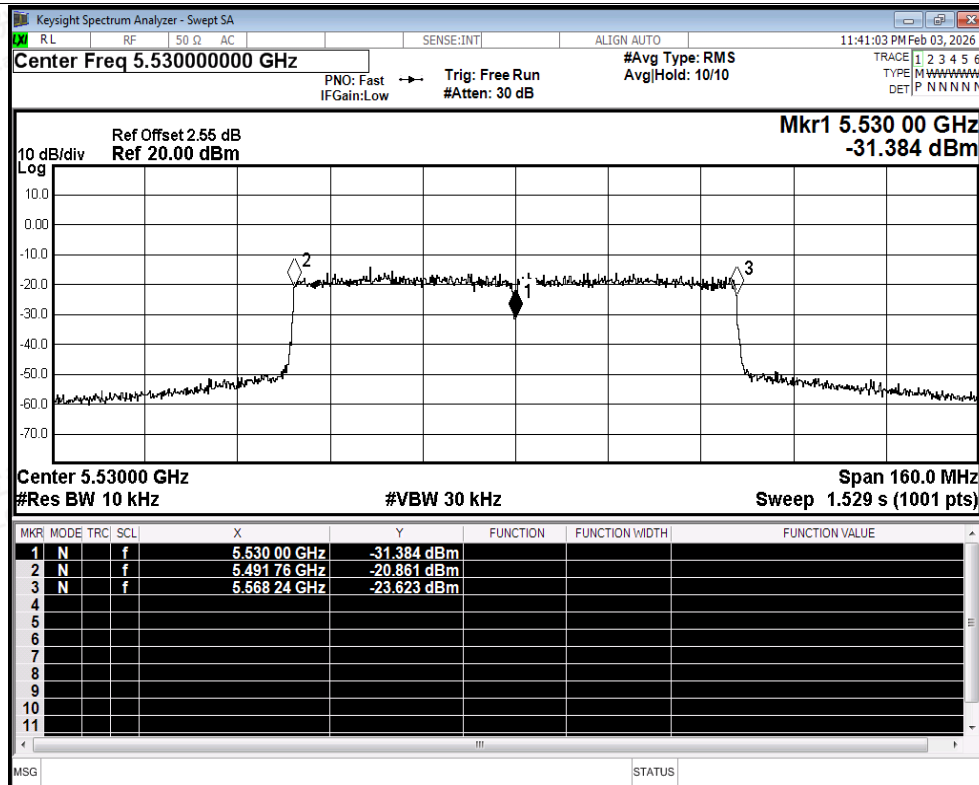

Freq. Stability NVNT ac80 5530MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

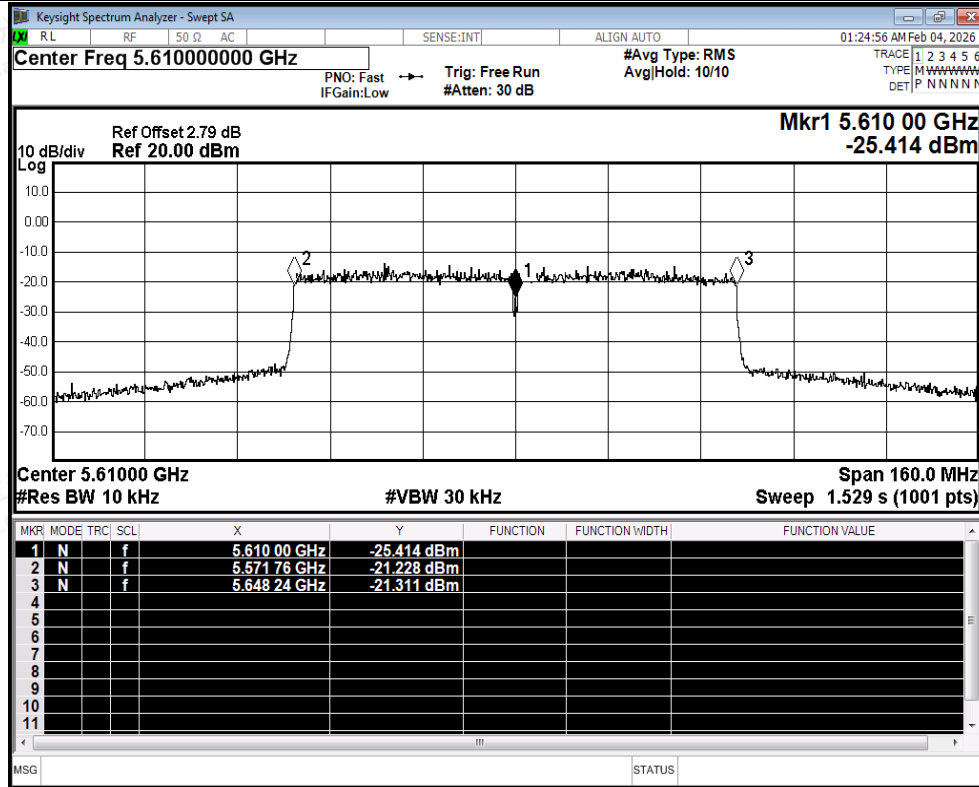

Freq. Stability NVNT ac80 5610MHz Ant1

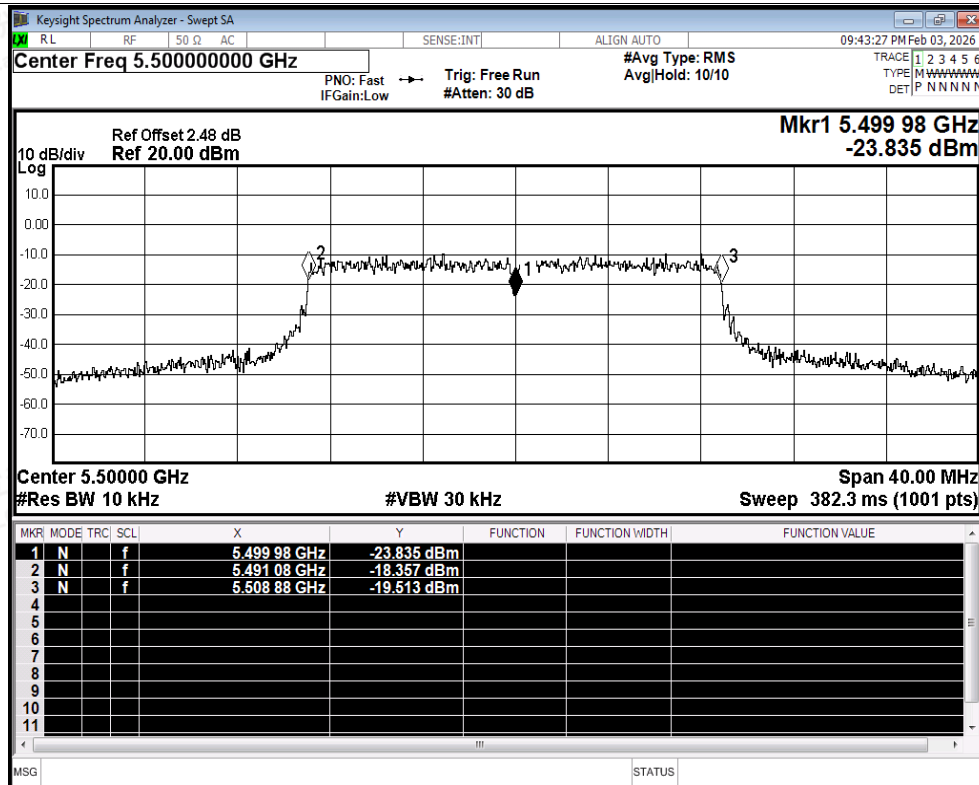

Freq. Stability NVNT ax20 5500MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

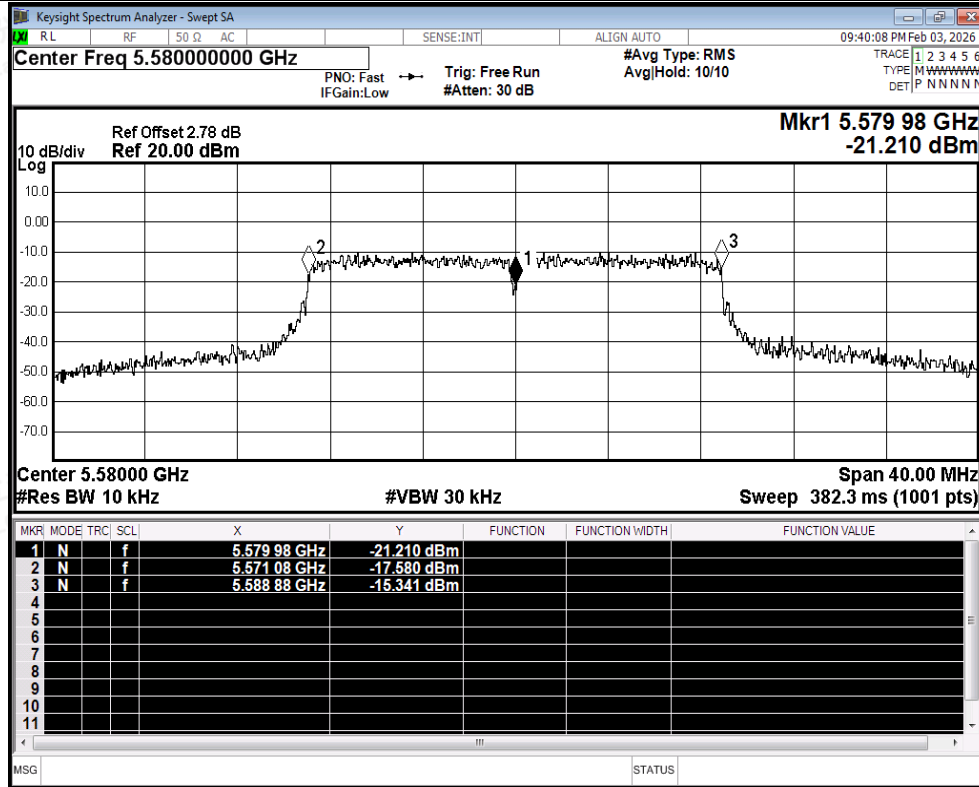

Freq. Stability NVNT ax20 5580MHz Ant1

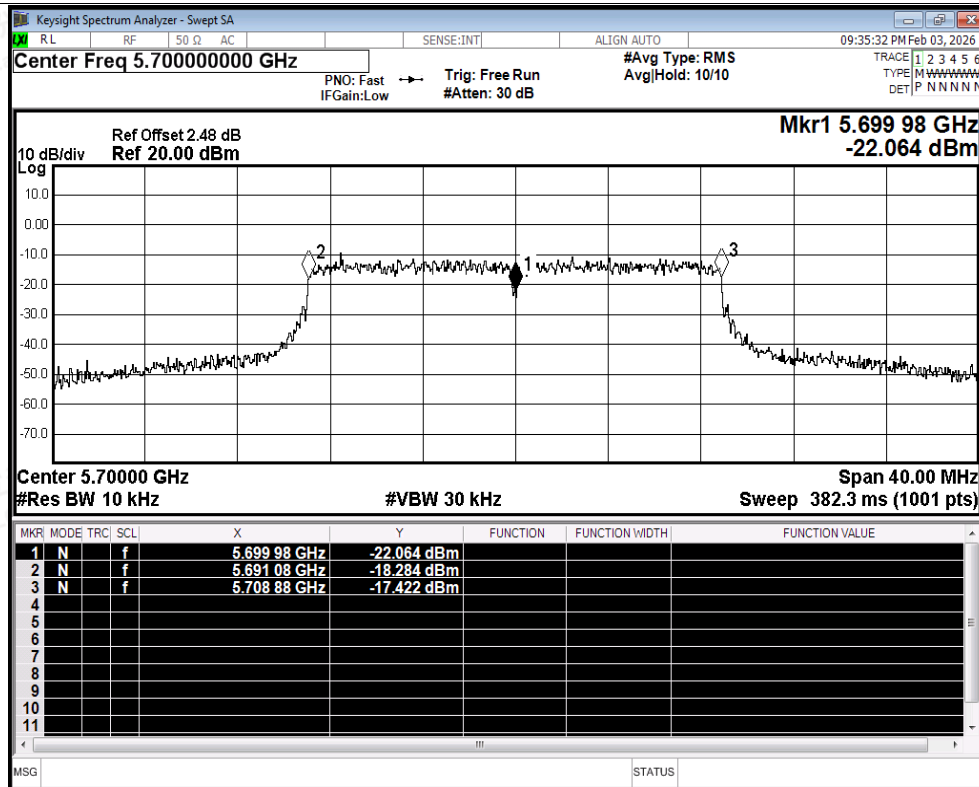

Freq. Stability NVNT ax20 5700MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

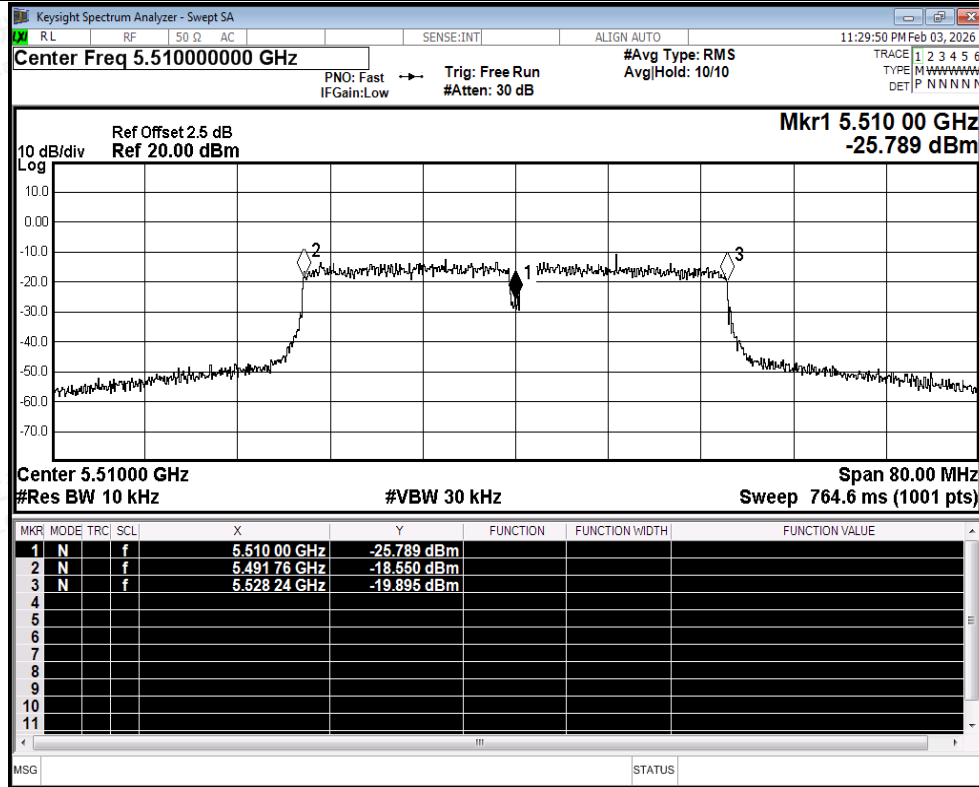

Freq. Stability NVNT ax40 5510MHz Ant1

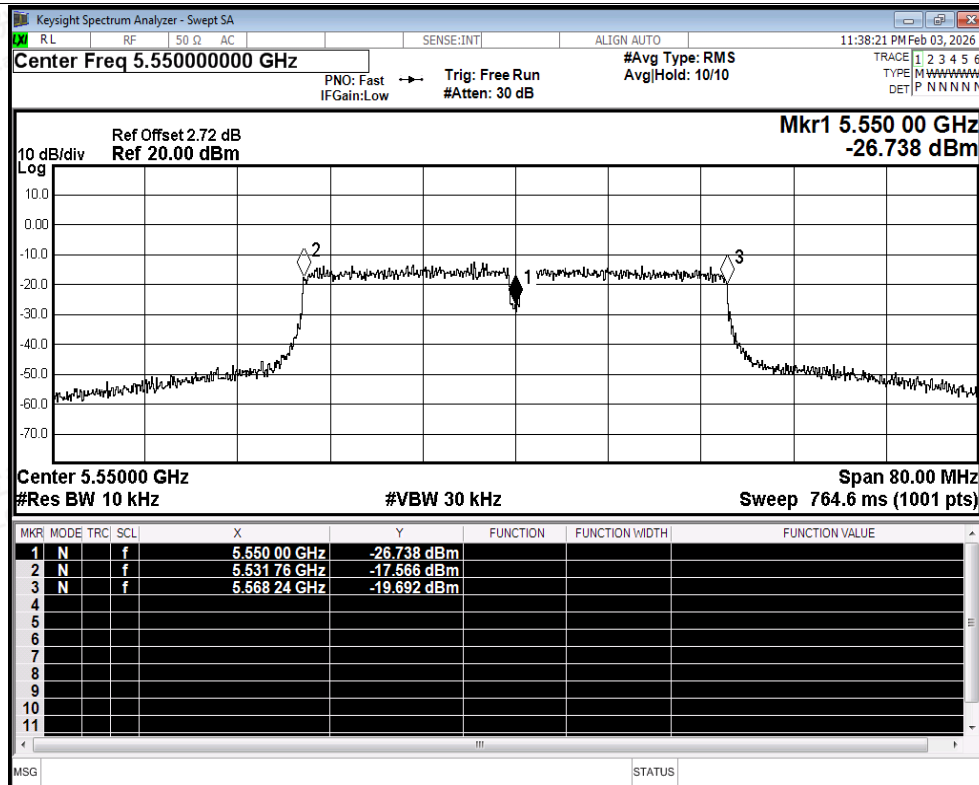

Freq. Stability NVNT ax40 5550MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

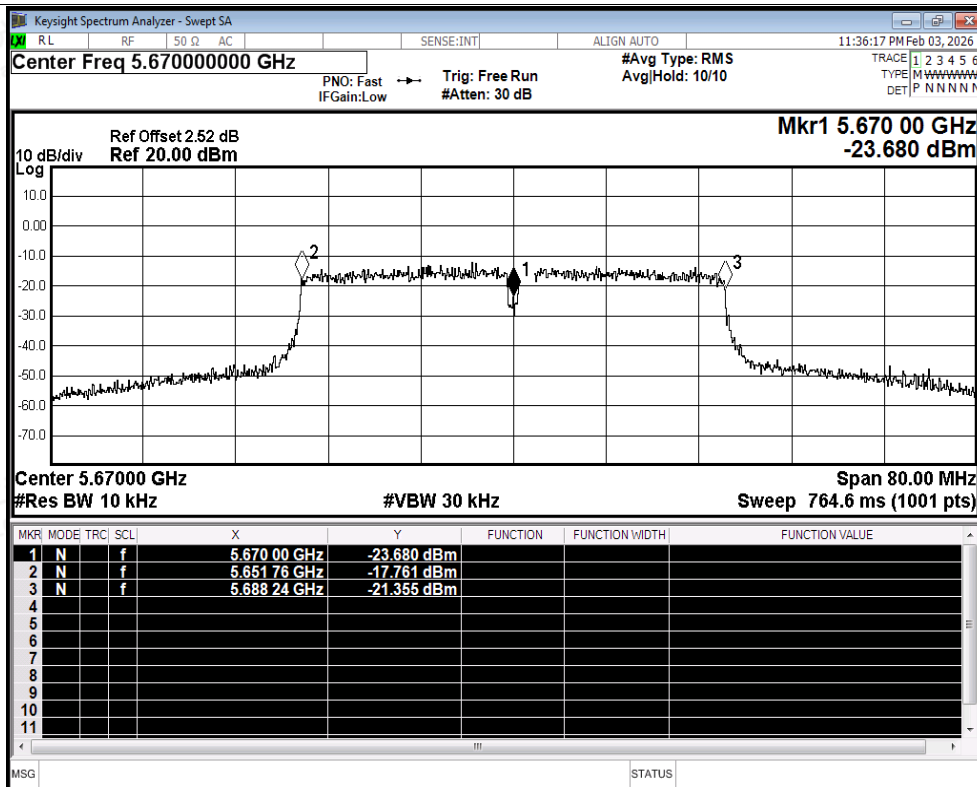

Freq. Stability NVNT ax40 5670MHz Ant1

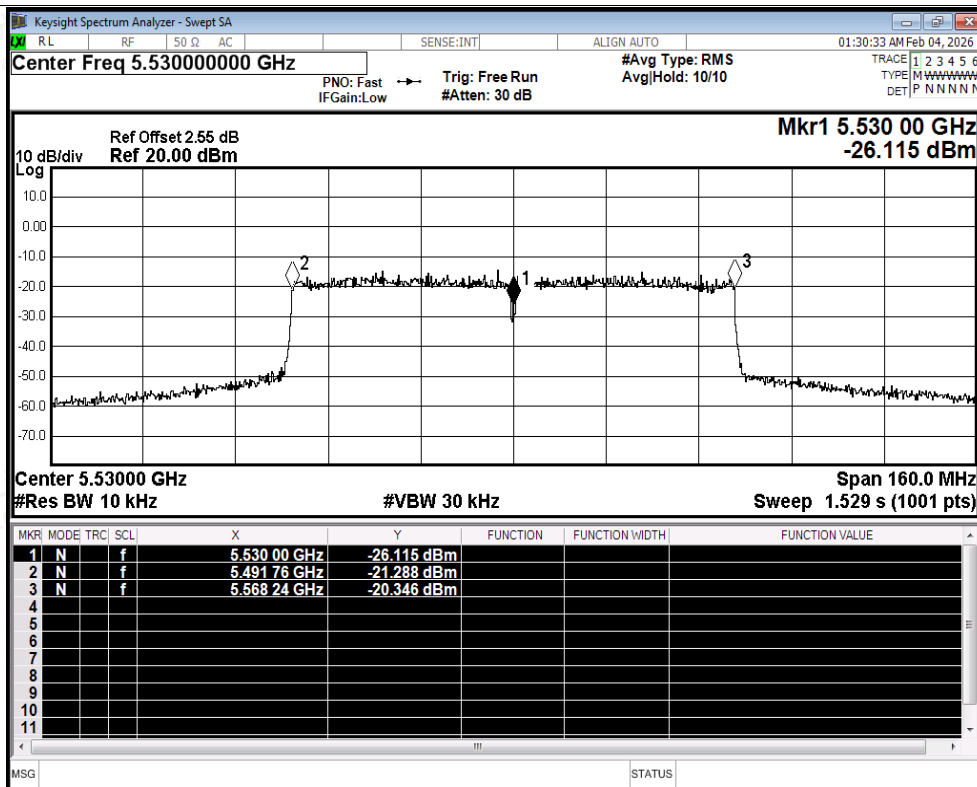

Freq. Stability NVNT ax80 5530MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

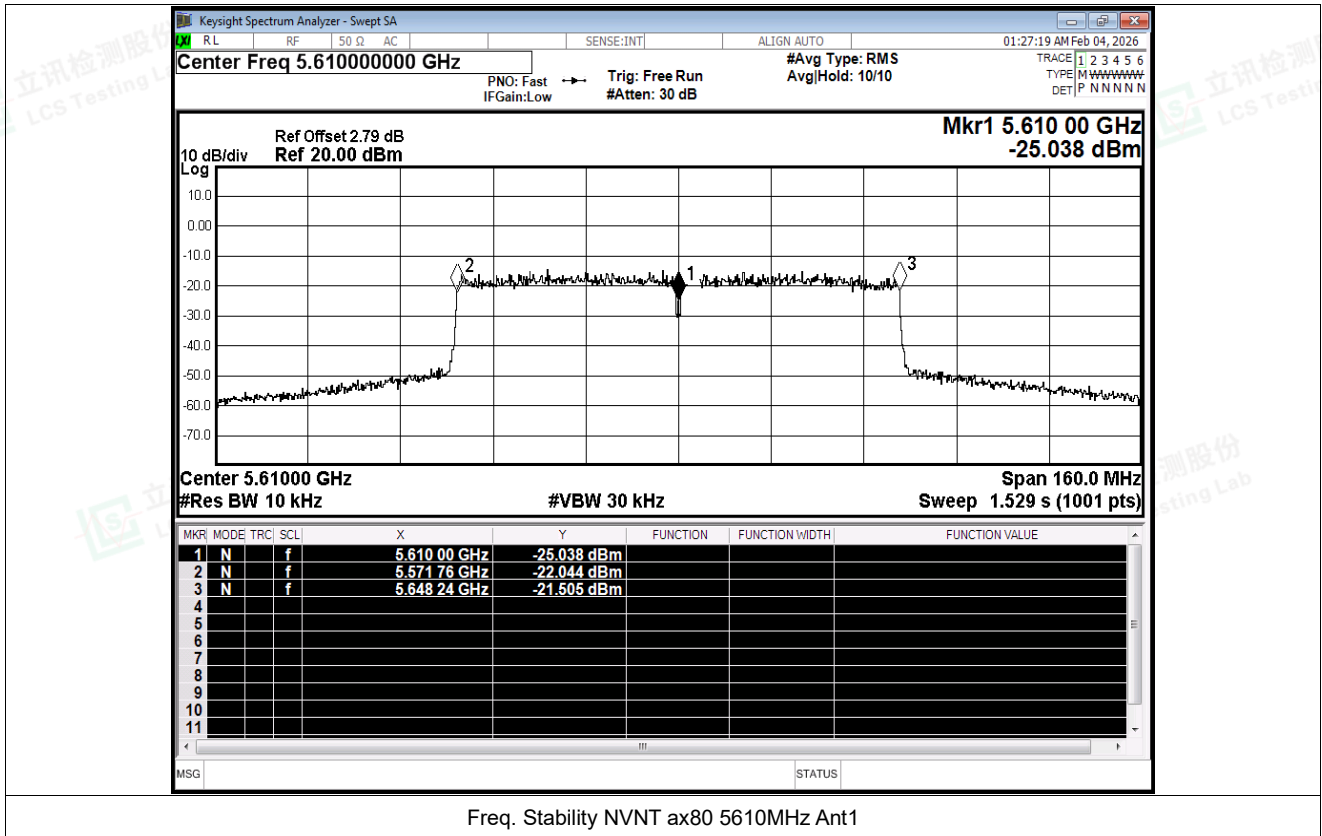

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5500	Ant2	5499.98	-20000	-3.64	25	Pass
NVNT	a	5580	Ant2	5579.98	-20000	-3.58	25	Pass
NVNT	a	5700	Ant2	5700	0	0	25	Pass
NVNT	n20	5500	Ant2	5500	0	0	25	Pass
NVNT	n20	5580	Ant2	5579.98	-20000	-3.58	25	Pass
NVNT	n20	5700	Ant2	5700	0	0	25	Pass
NVNT	n40	5510	Ant2	5510	0	0	25	Pass
NVNT	n40	5550	Ant2	5549.96	-40000	-7.21	25	Pass
NVNT	n40	5670	Ant2	5670	0	0	25	Pass
NVNT	ac20	5500	Ant2	5500	0	0	25	Pass
NVNT	ac20	5580	Ant2	5579.98	-20000	-3.58	25	Pass
NVNT	ac20	5700	Ant2	5699.98	-20000	-3.51	25	Pass
NVNT	ac40	5510	Ant2	5510	0	0	25	Pass
NVNT	ac40	5550	Ant2	5550	0	0	25	Pass
NVNT	ac40	5670	Ant2	5670	0	0	25	Pass
NVNT	ac80	5530	Ant2	5530	0	0	25	Pass
NVNT	ac80	5610	Ant2	5610	0	0	25	Pass
NVNT	ax20	5500	Ant2	5499.98	-20000	-3.64	25	Pass
NVNT	ax20	5580	Ant2	5579.98	-20000	-3.58	25	Pass
NVNT	ax20	5700	Ant2	5699.98	-20000	-3.51	25	Pass
NVNT	ax40	5510	Ant2	5510	0	0	25	Pass
NVNT	ax40	5550	Ant2	5550	0	0	25	Pass
NVNT	ax40	5670	Ant2	5670	0	0	25	Pass
NVNT	ax80	5530	Ant2	5530	0	0	25	Pass
NVNT	ax80	5610	Ant2	5609.92	-80000	-14.26	25	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity