
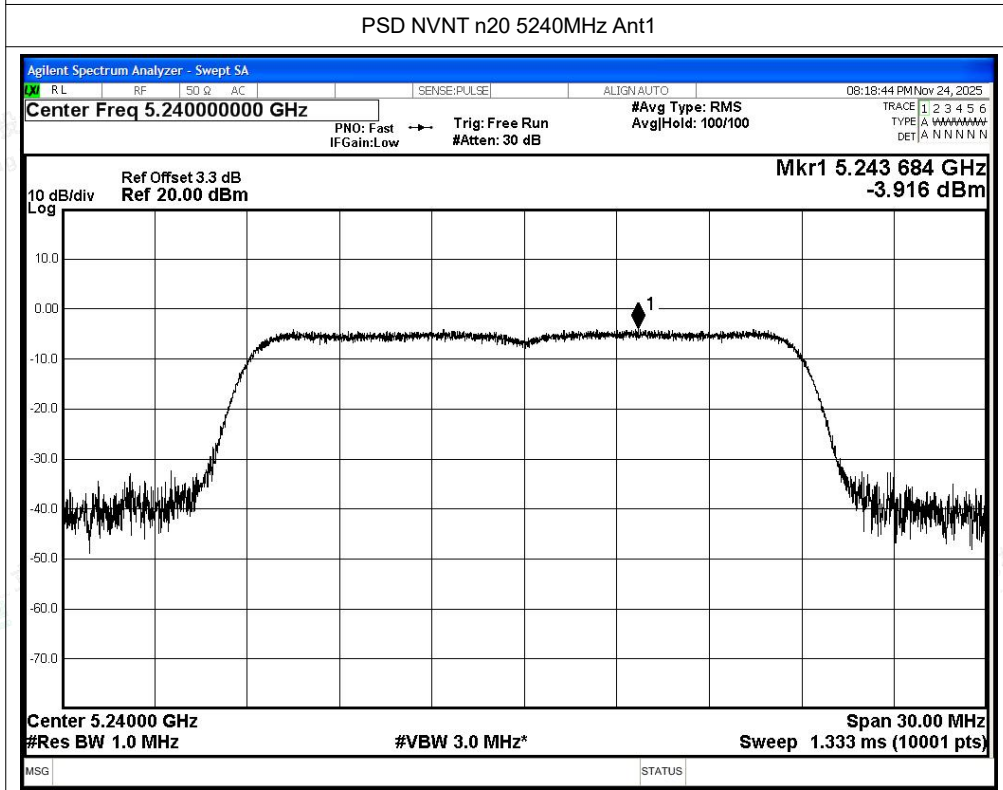



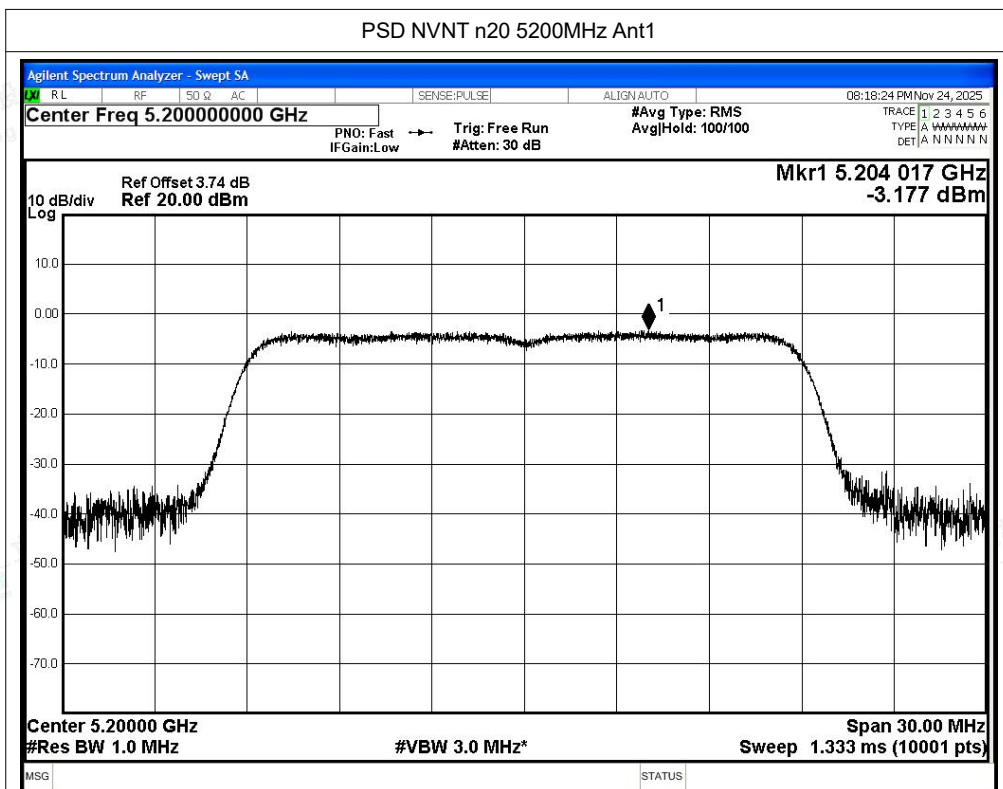


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

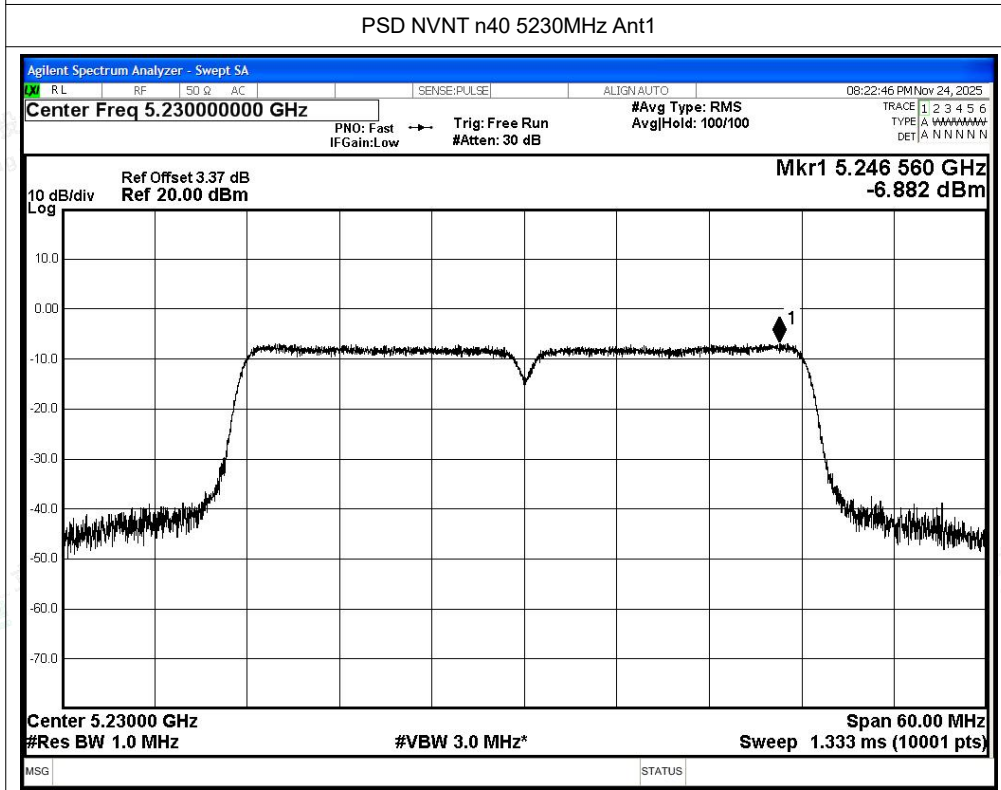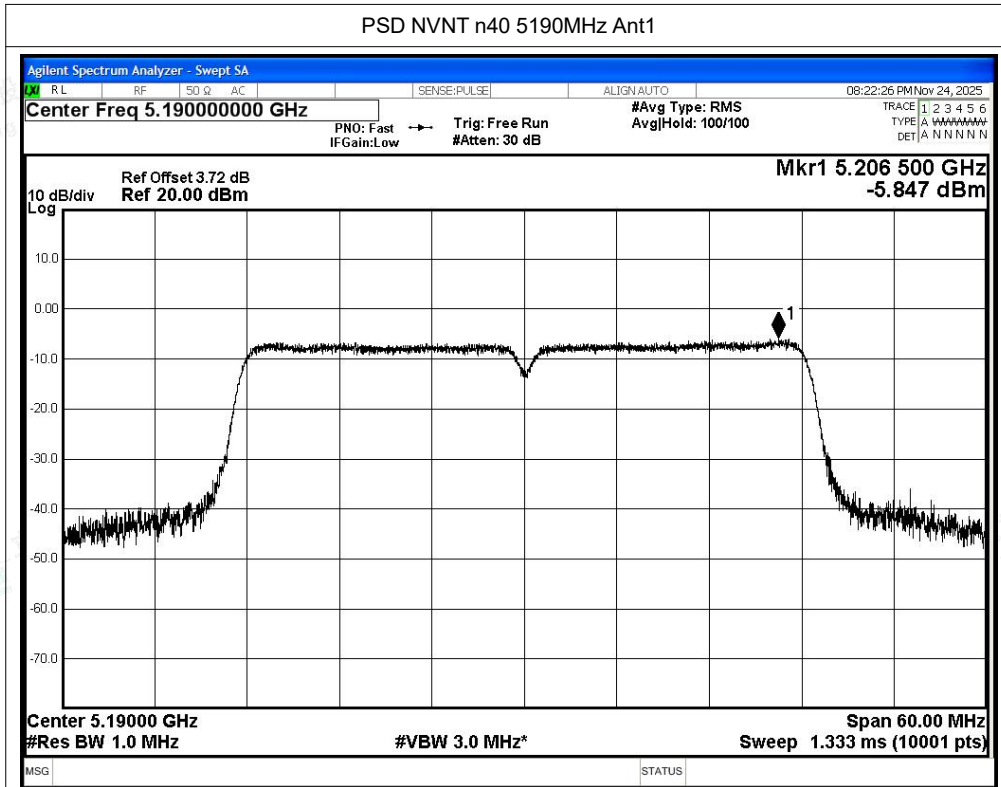

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ac20 5180MHz Ant1

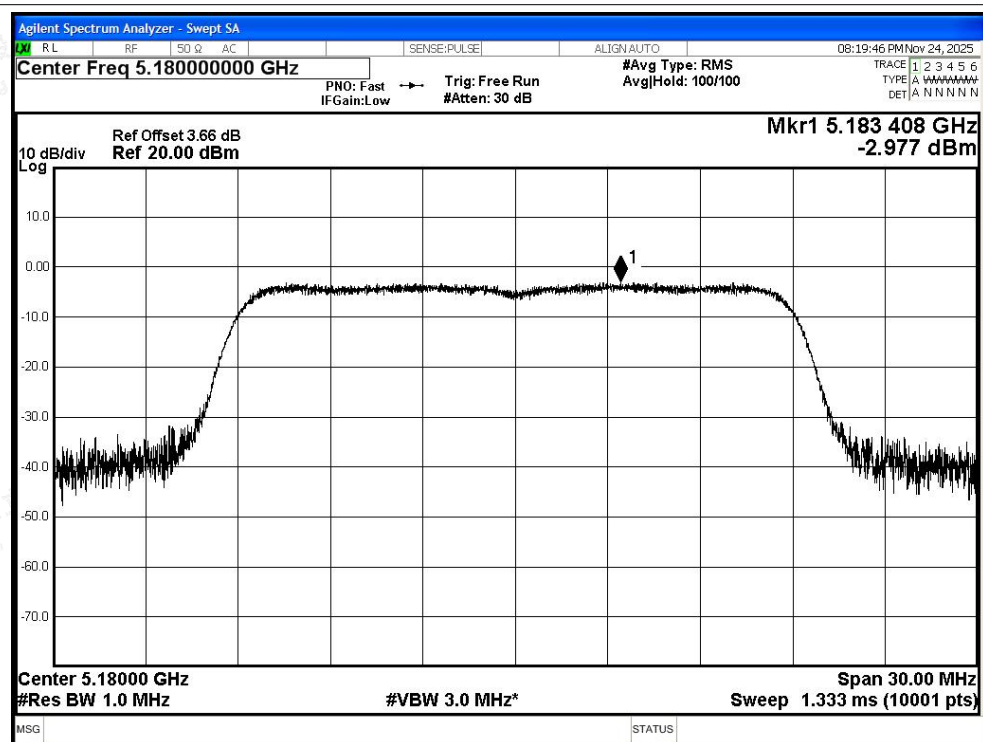

PSD NVNT ac20 5200MHz Ant1

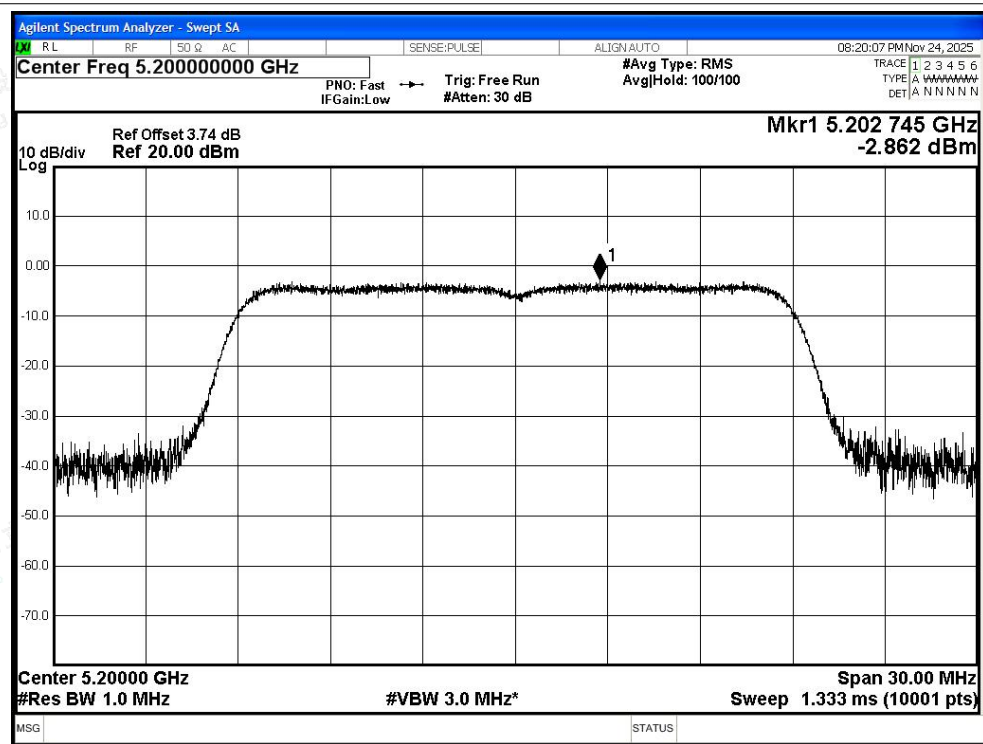

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ac20 5240MHz Ant1

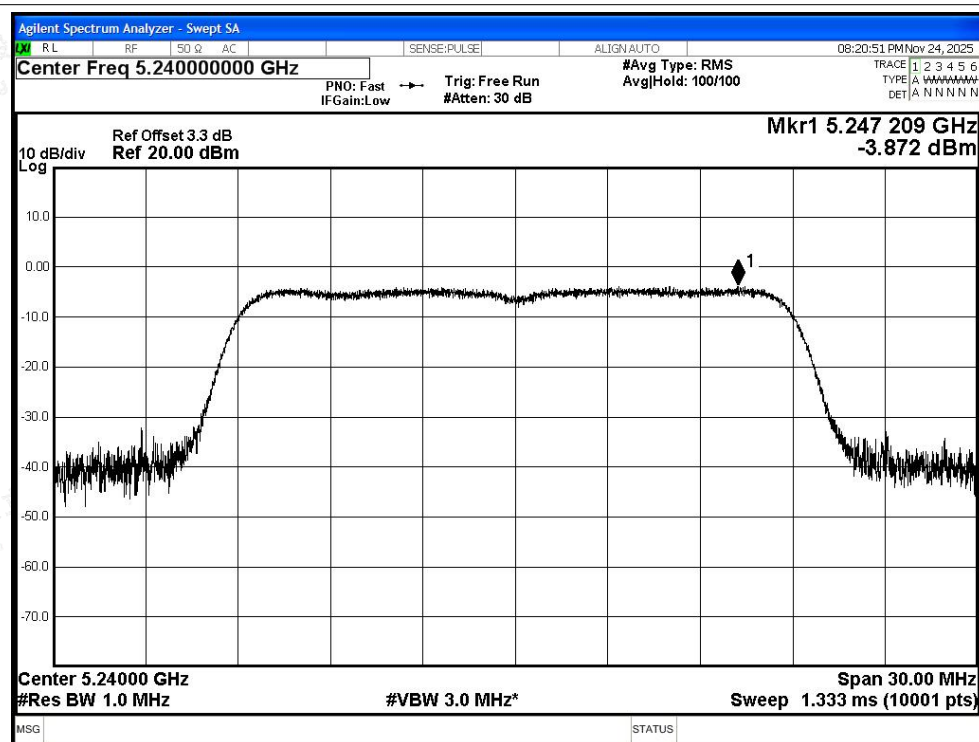

PSD NVNT ac40 5190MHz Ant1

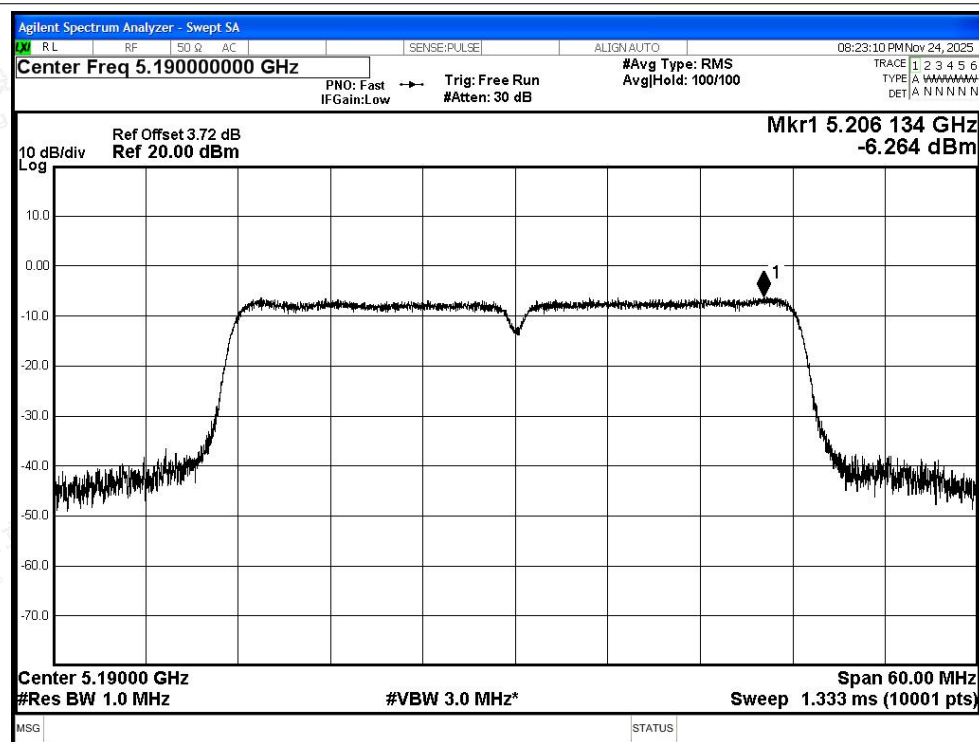

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ac40 5230MHz Ant1

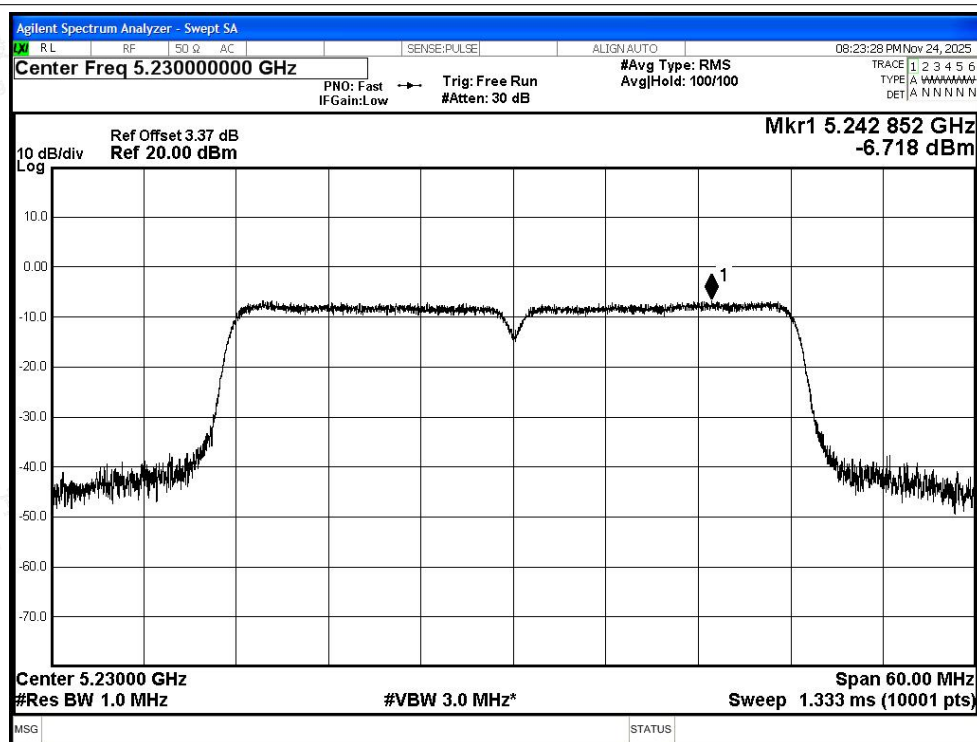

PSD NVNT ac80 5210MHz Ant1

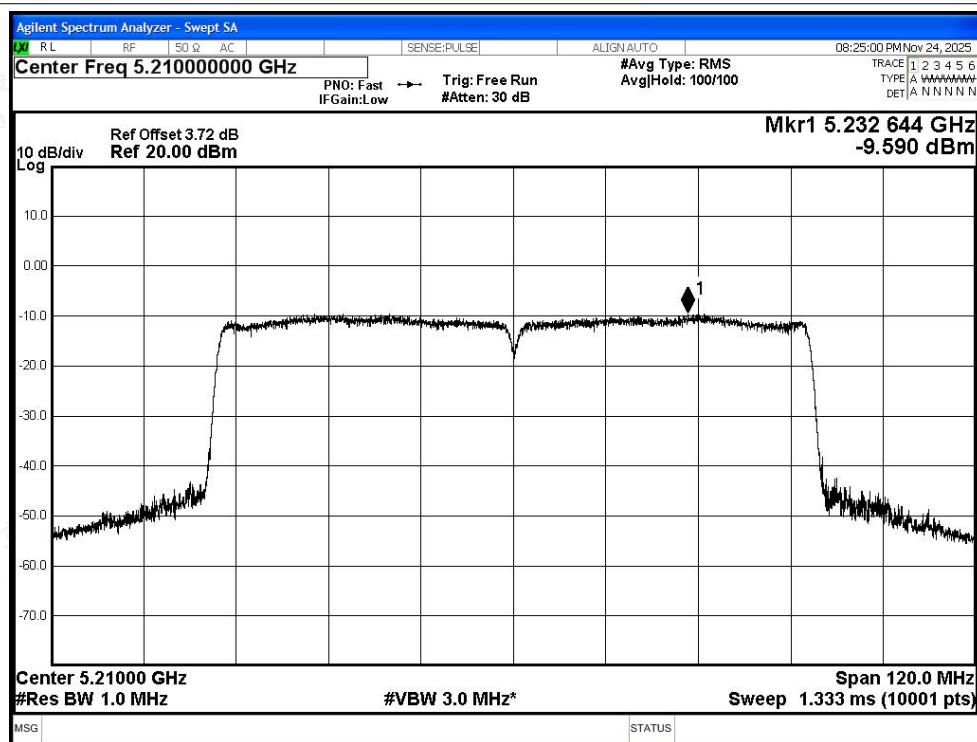

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ax20 5180MHz Ant1

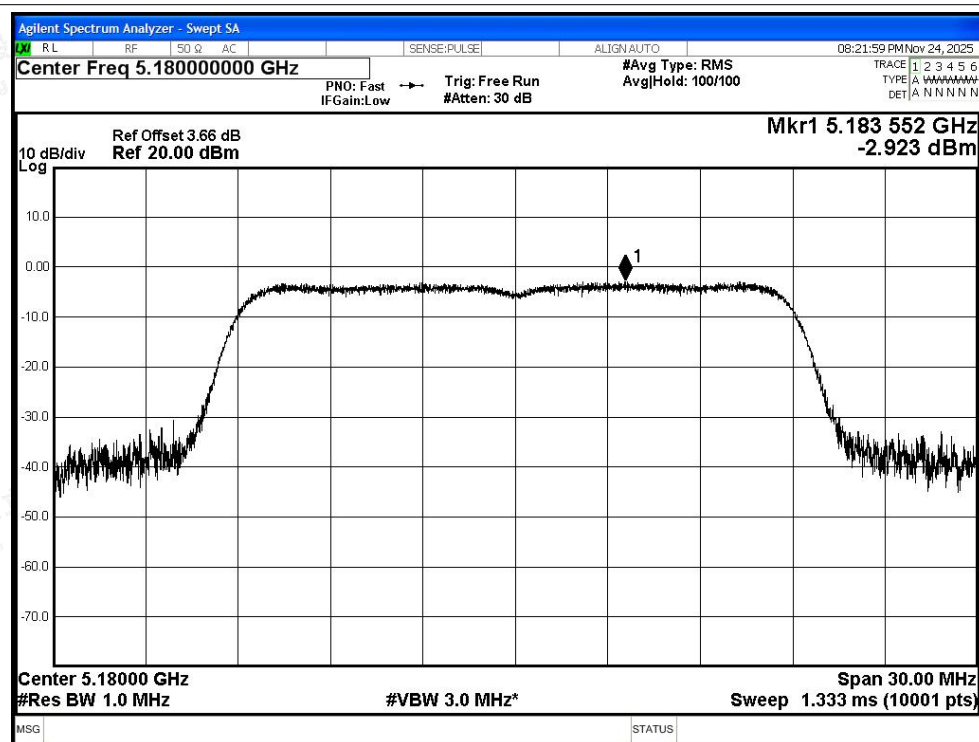

PSD NVNT ax20 5200MHz Ant1

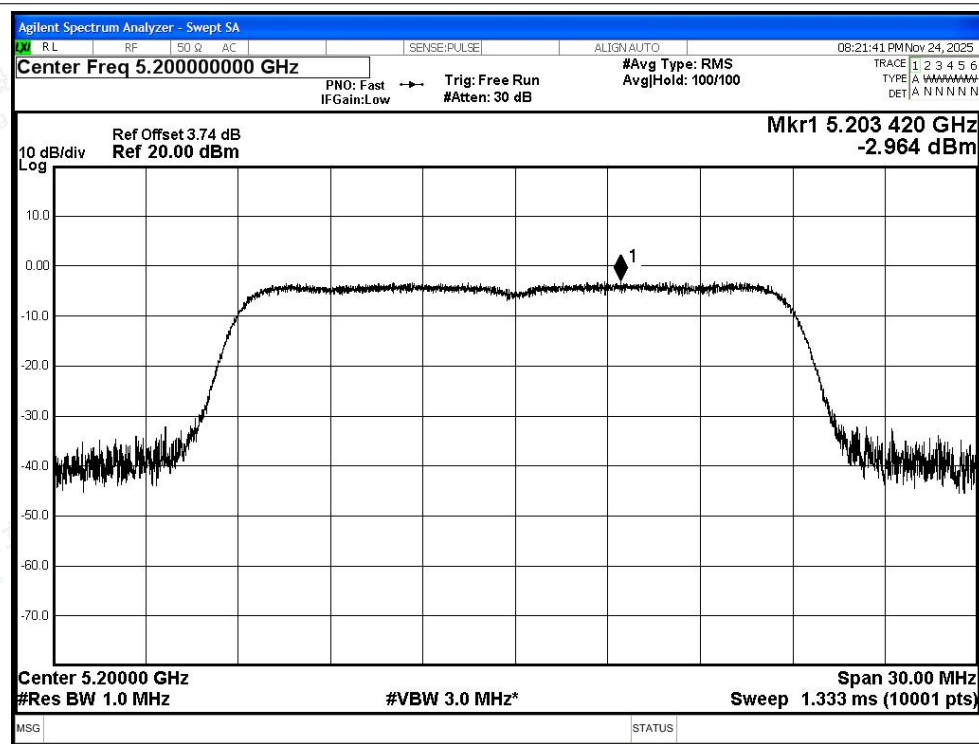

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ax20 5240MHz Ant1

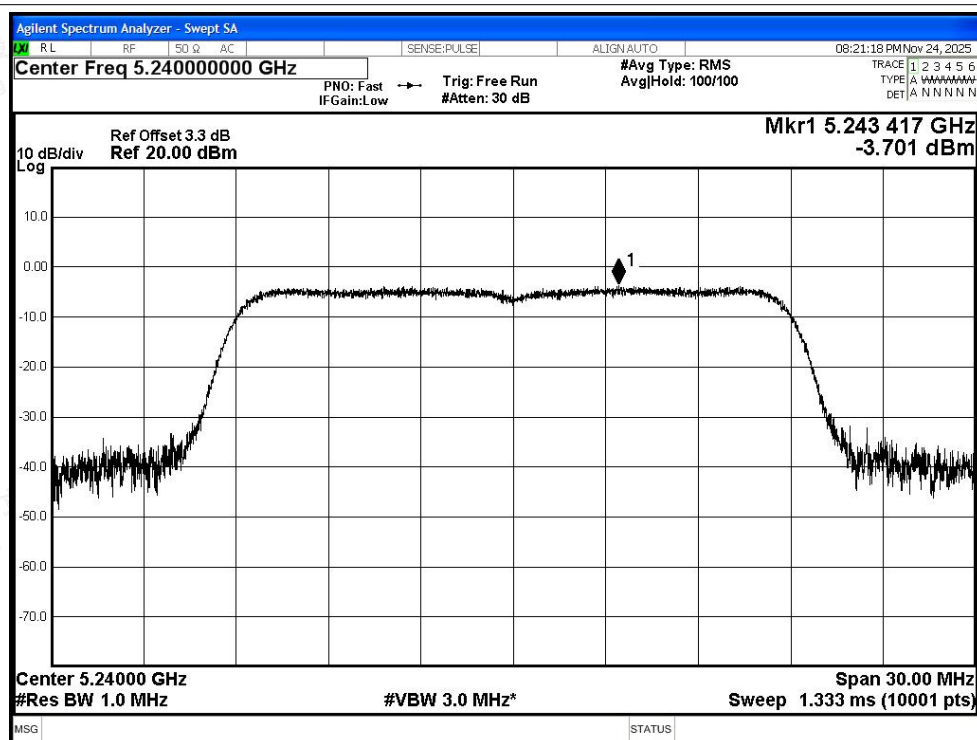

PSD NVNT ax40 5190MHz Ant1

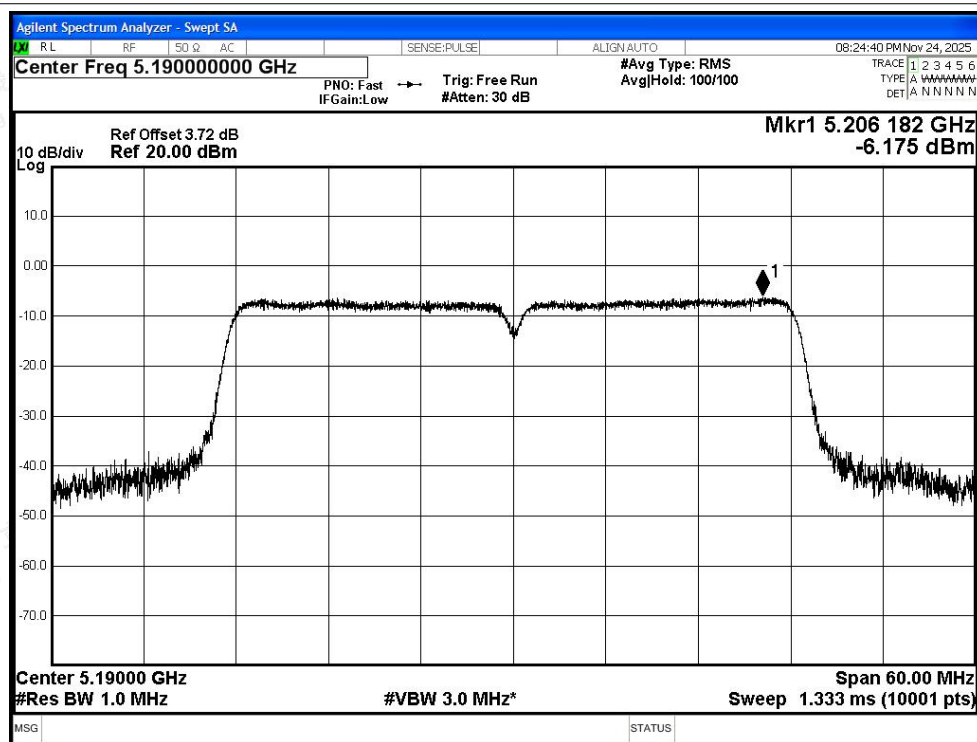

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ax40 5230MHz Ant1

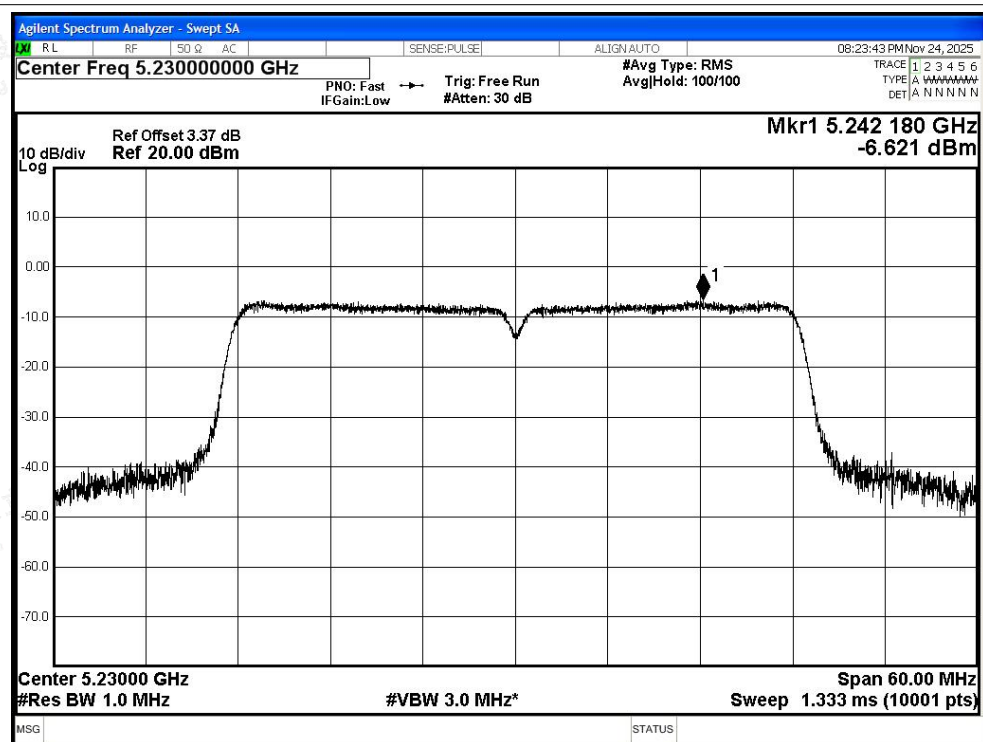

PSD NVNT ax80 5210MHz Ant1

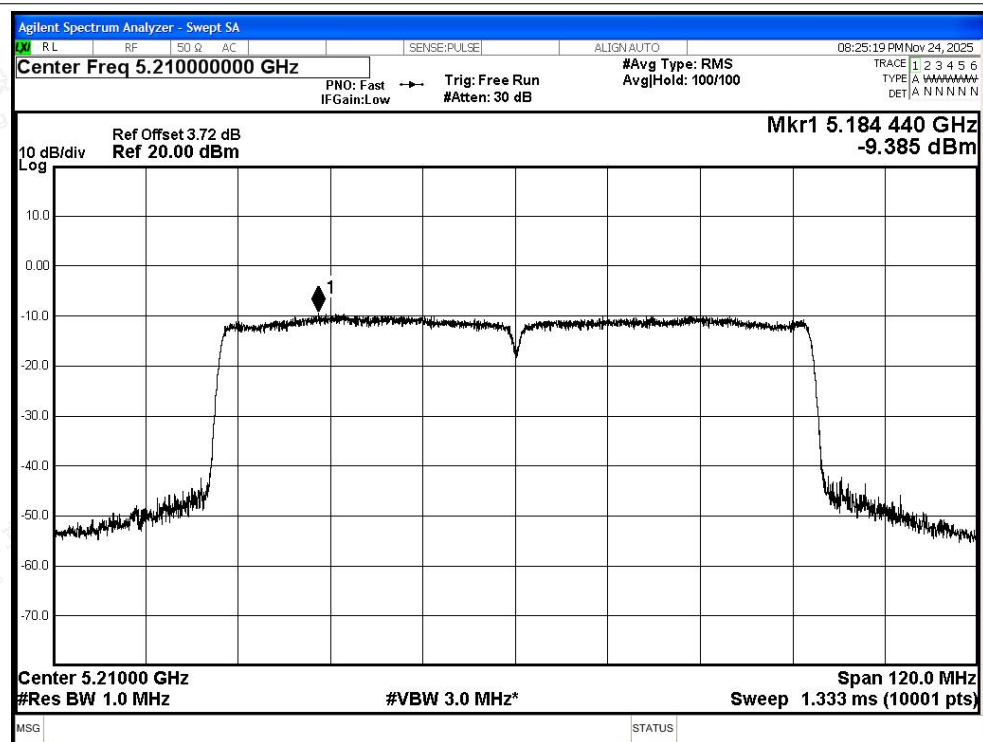

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

PSD NVNT a 5180MHz Ant2

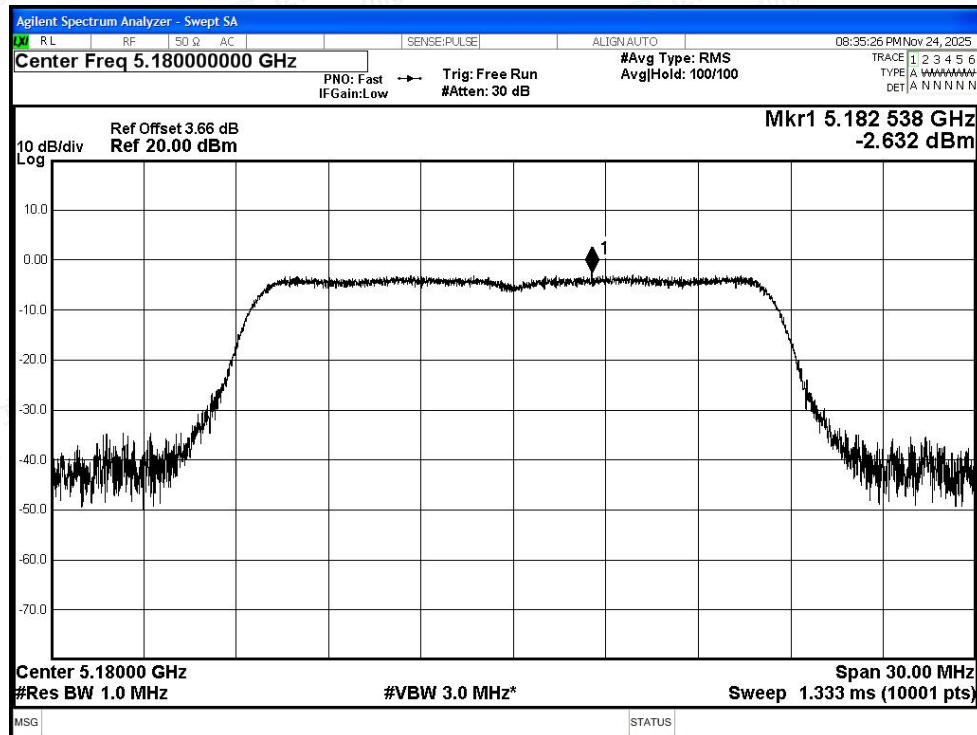

PSD NVNT a 5200MHz Ant2

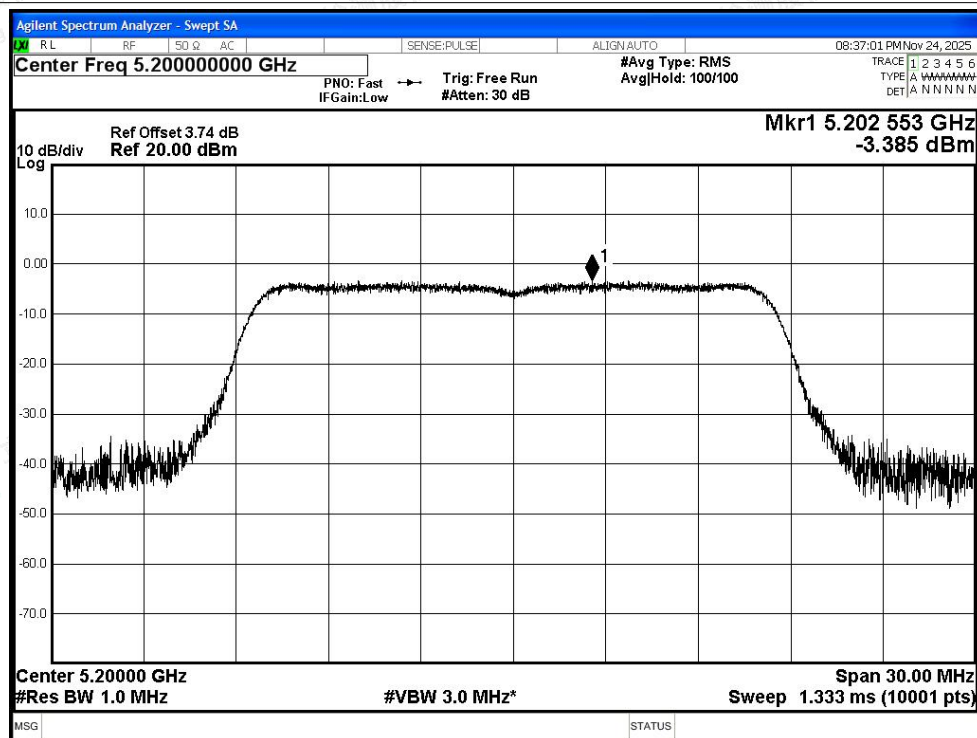

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT a 5240MHz Ant2

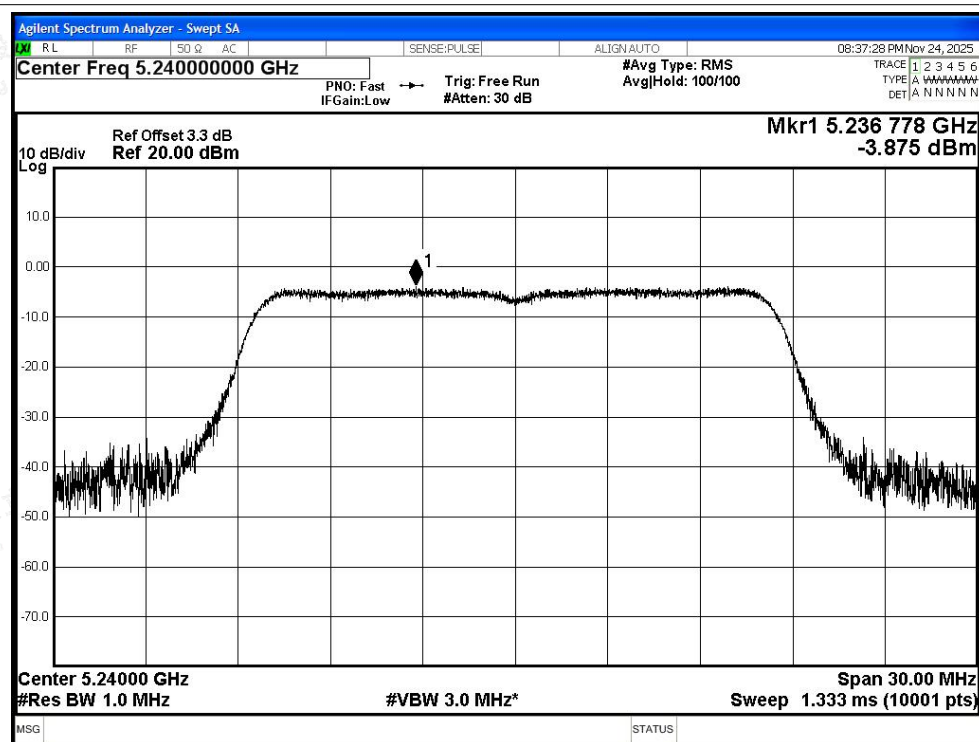

PSD NVNT n20 5180MHz Ant2


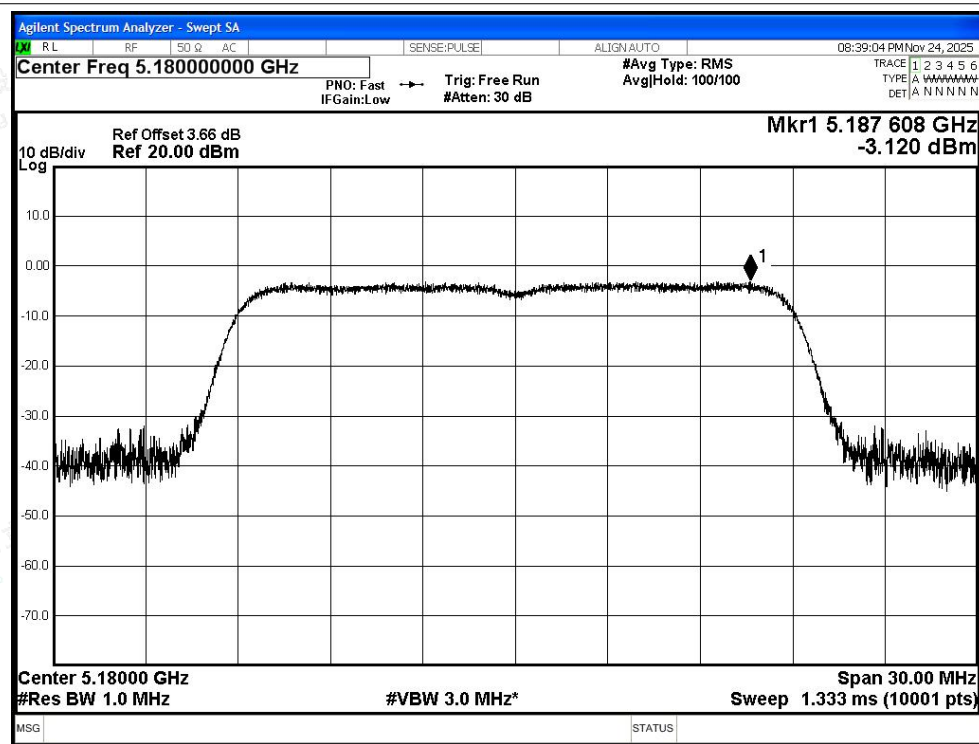


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

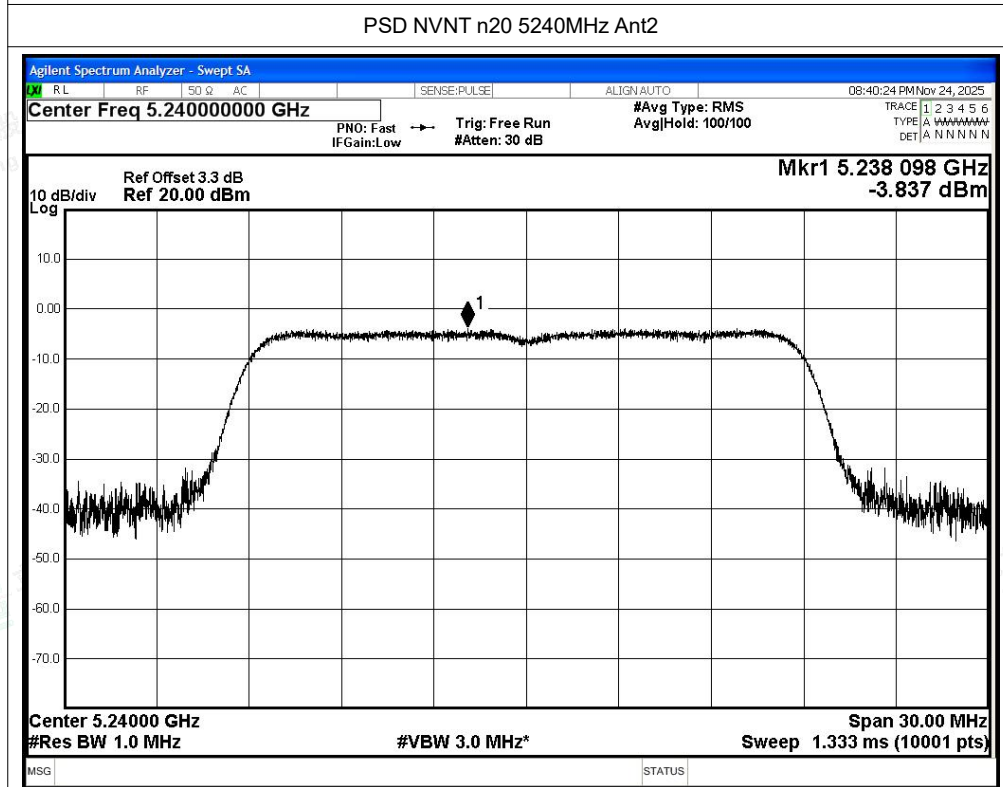
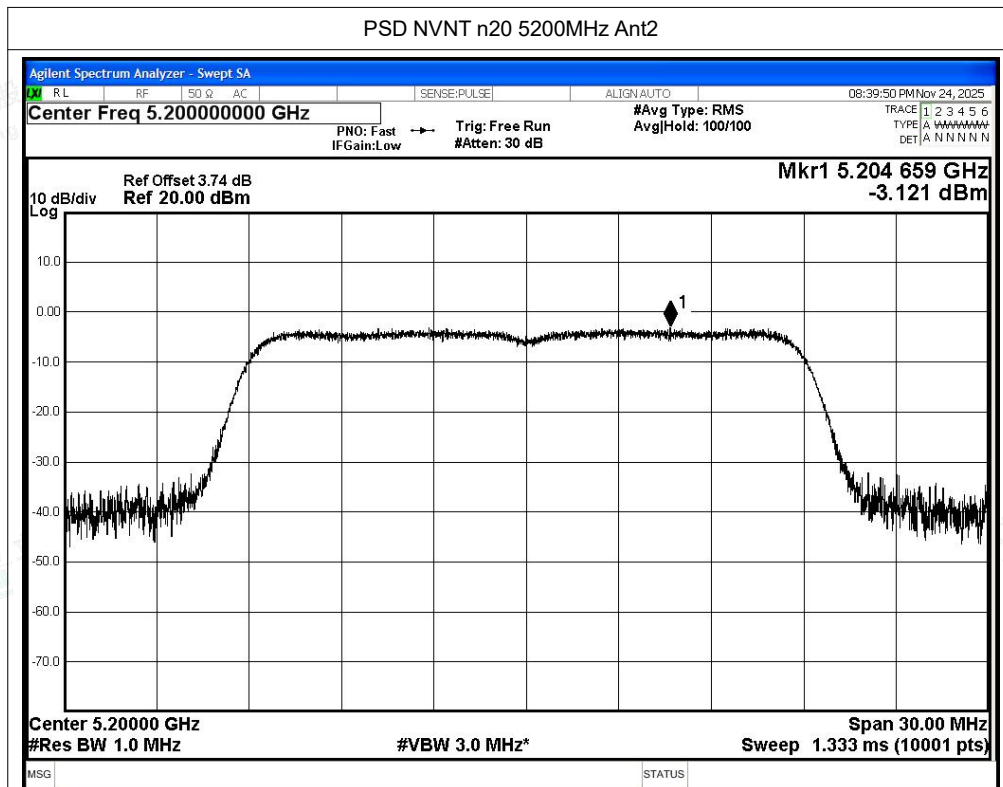


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

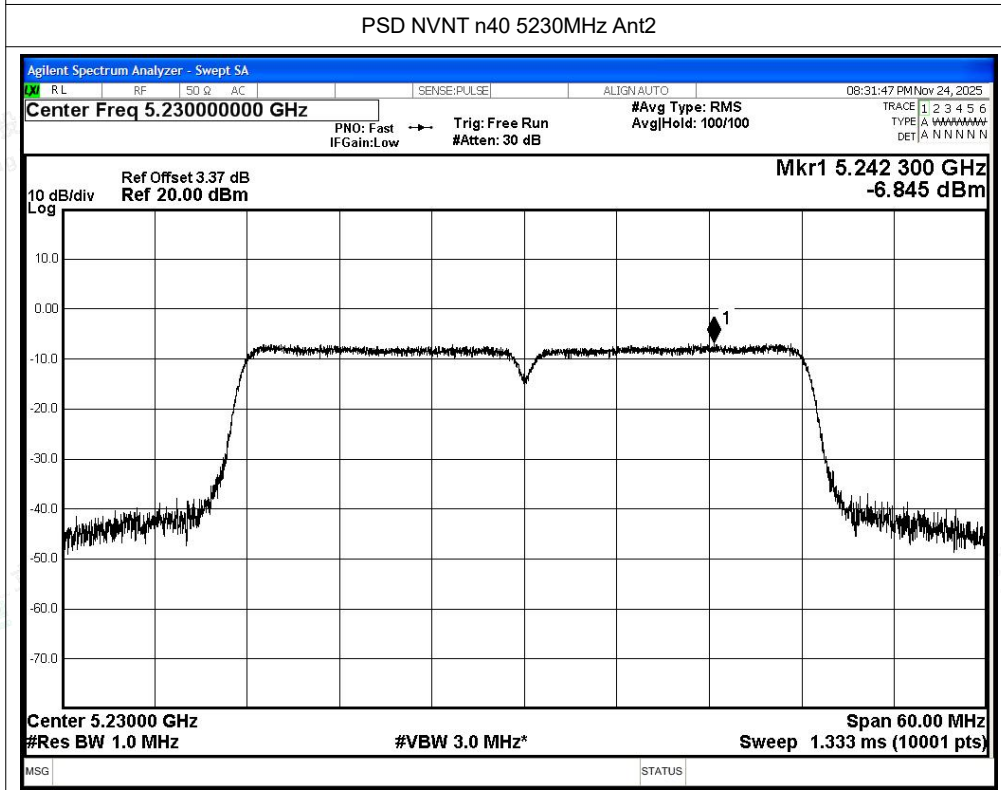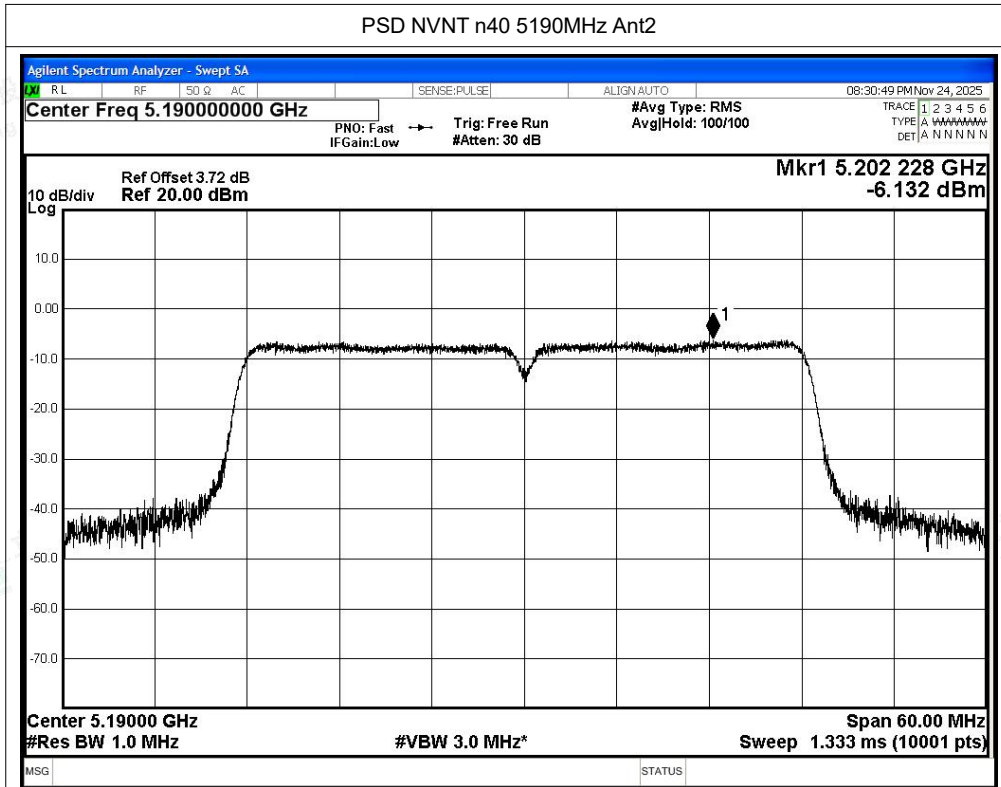

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ac20 5180MHz Ant2

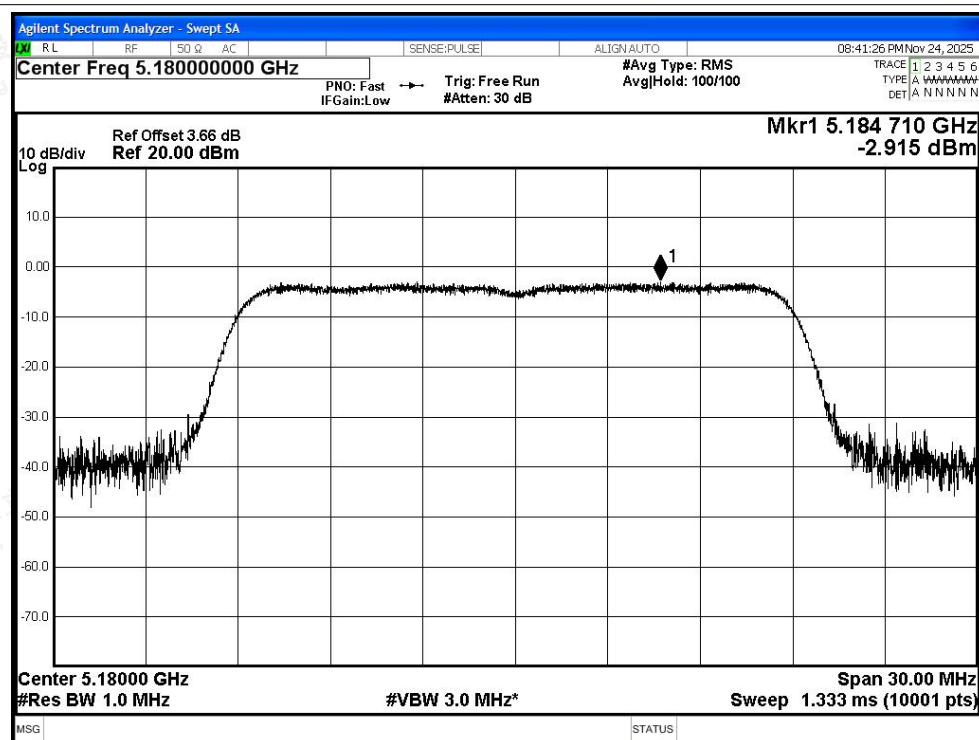

PSD NVNT ac20 5200MHz Ant2

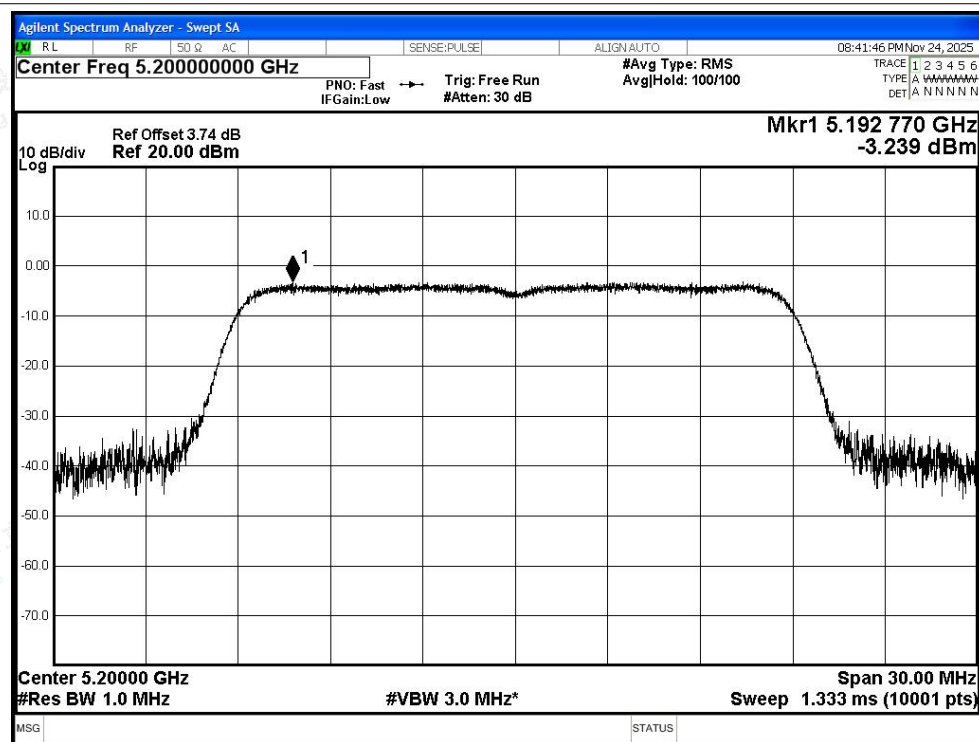

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ac20 5240MHz Ant2

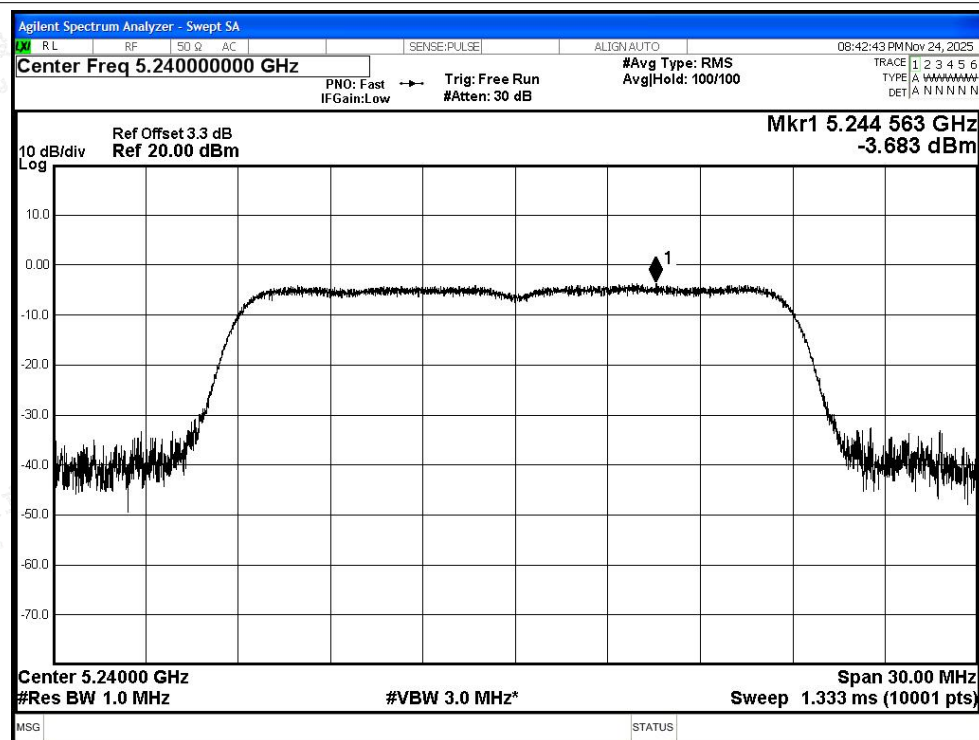

PSD NVNT ac40 5190MHz Ant2

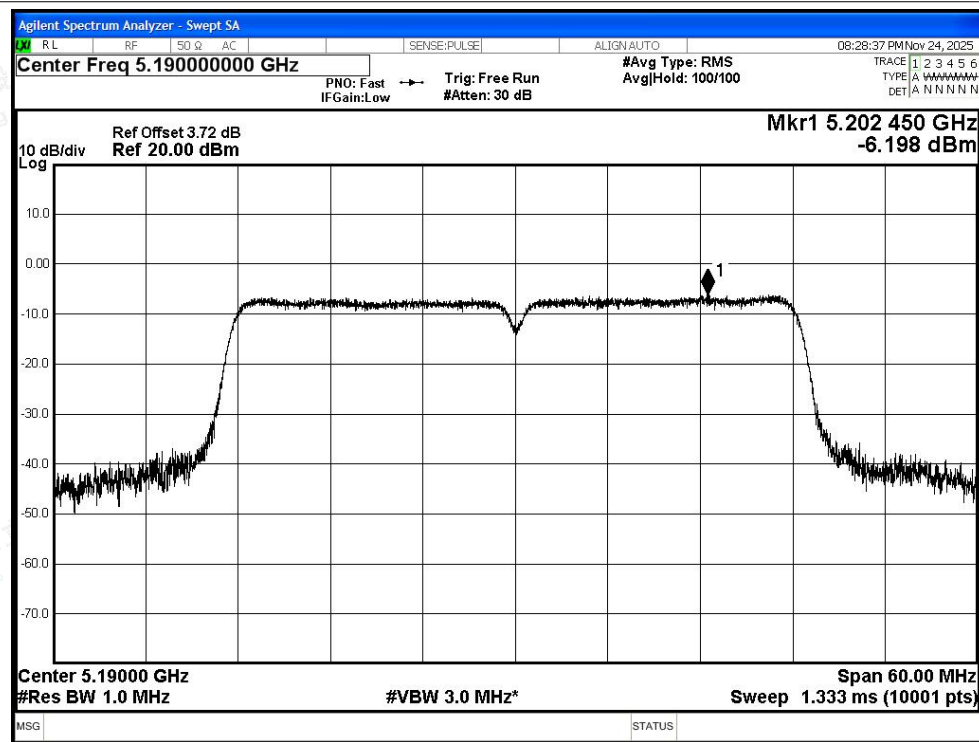

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ac40 5230MHz Ant2

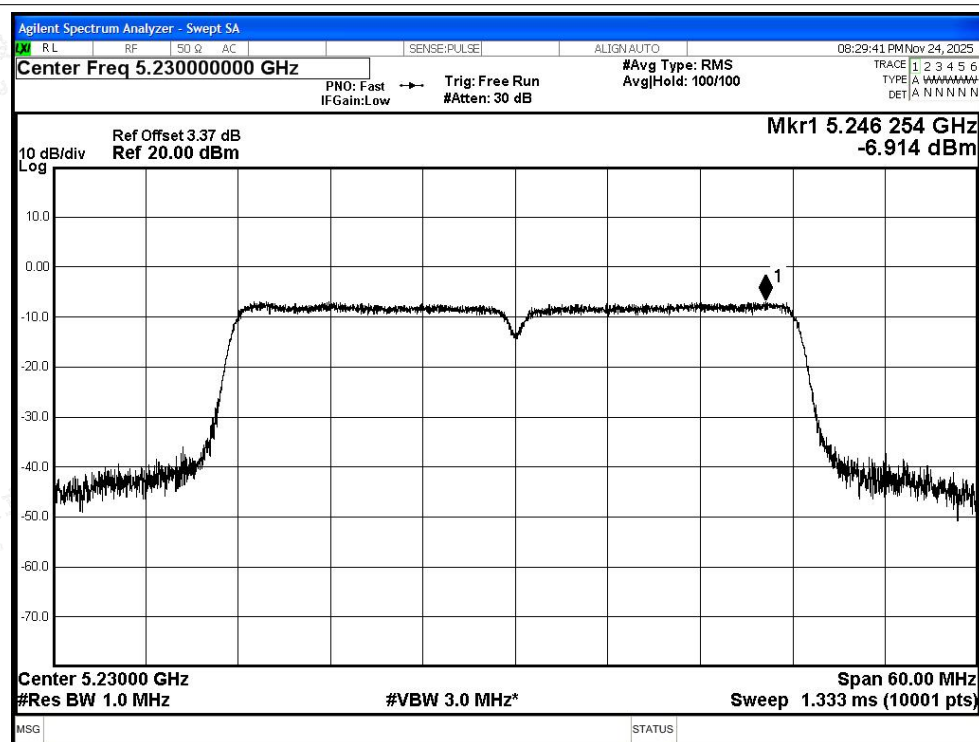

PSD NVNT ac80 5210MHz Ant2

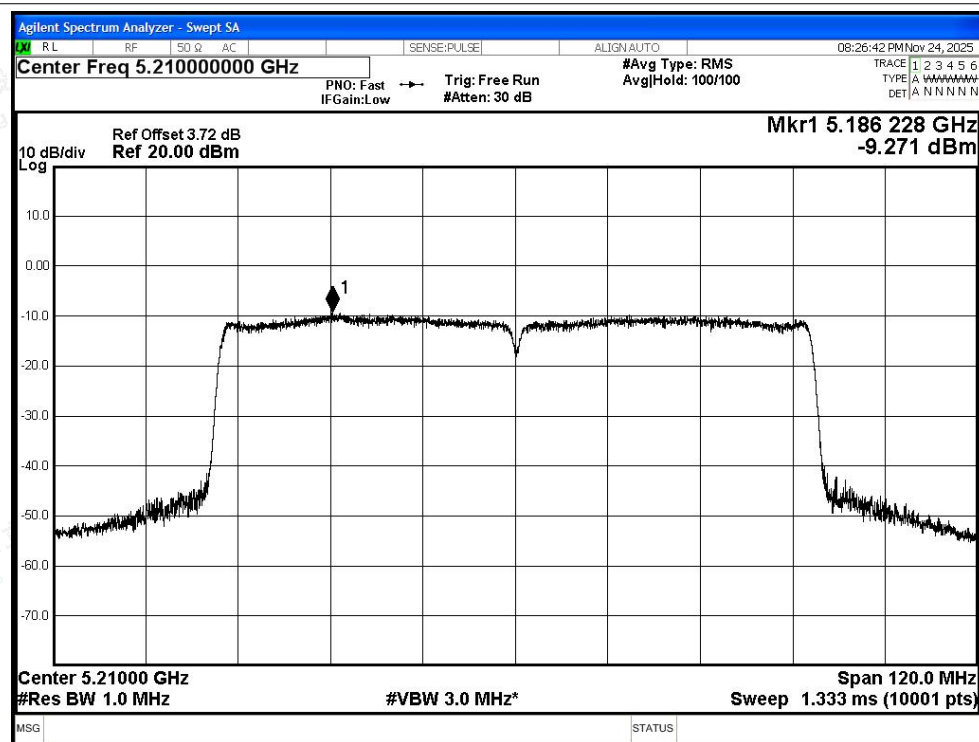

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ax20 5180MHz Ant2

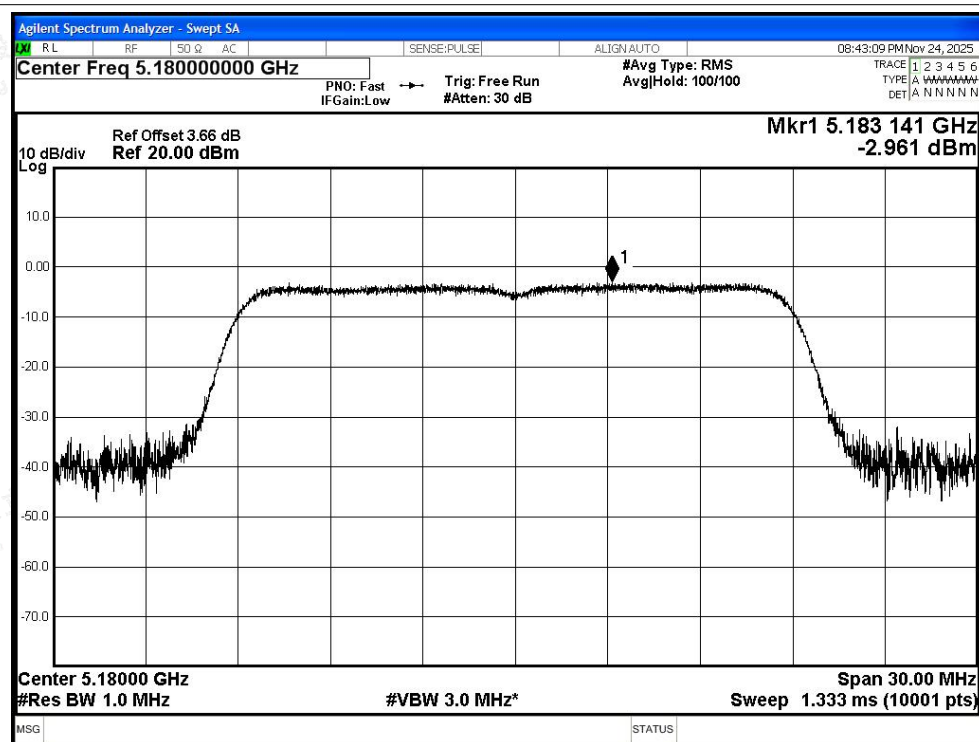

PSD NVNT ax20 5200MHz Ant2

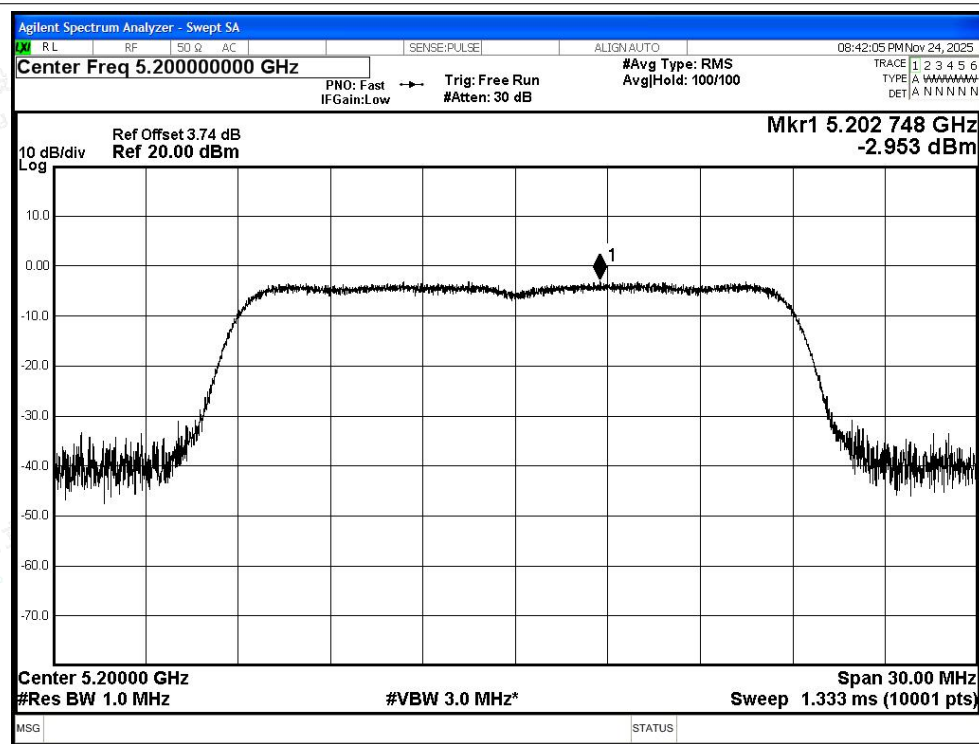

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ax20 5240MHz Ant2

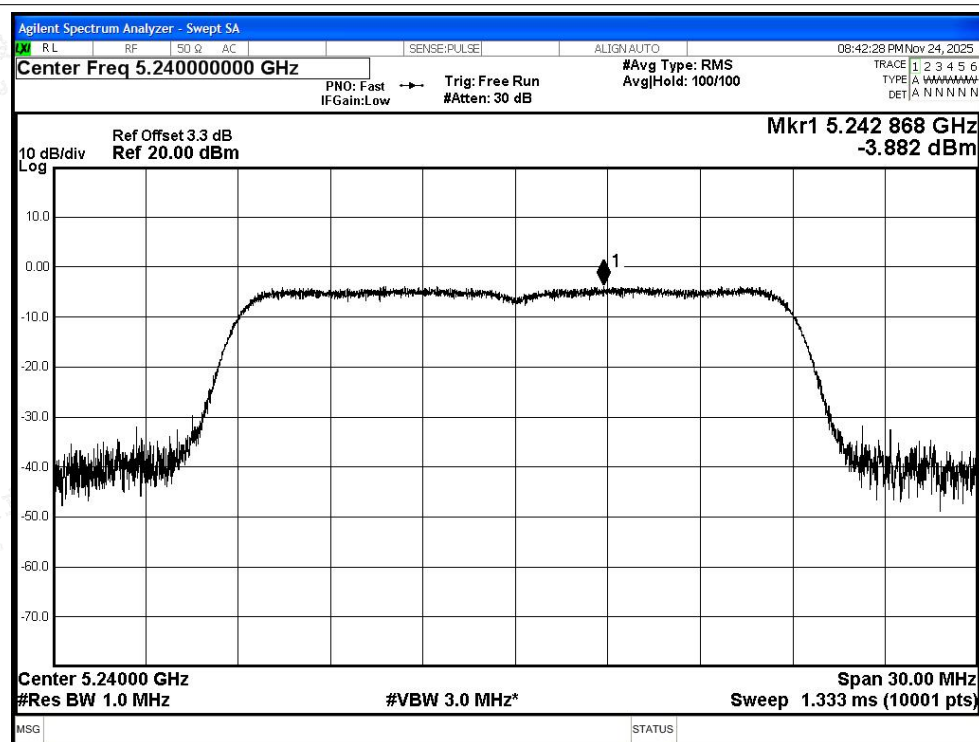

PSD NVNT ax40 5190MHz Ant2

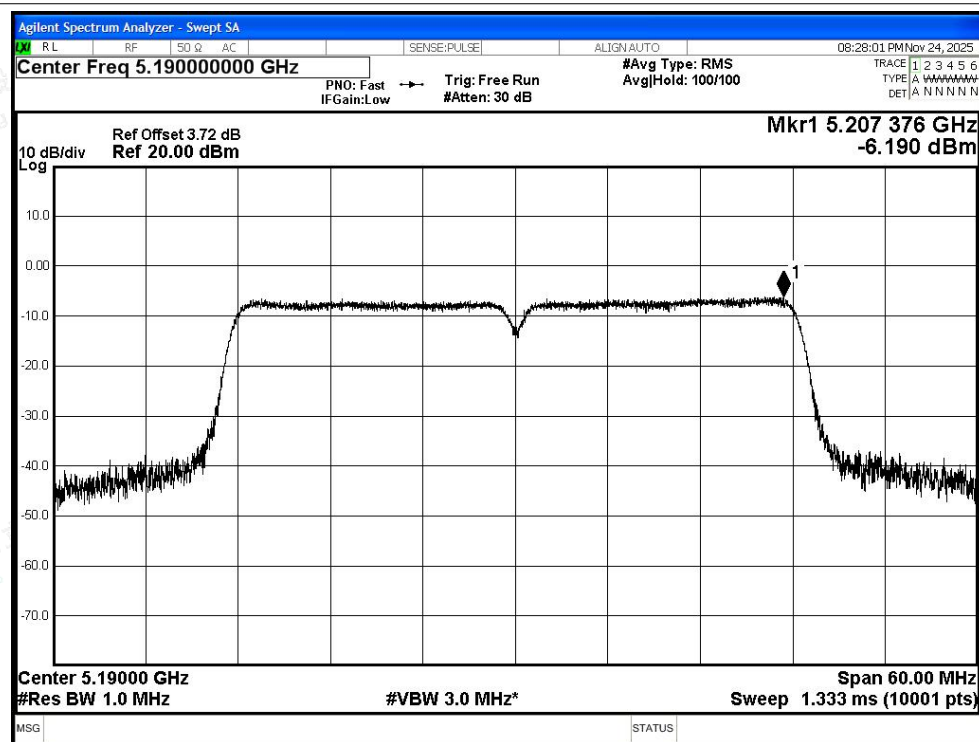

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ax40 5230MHz Ant2

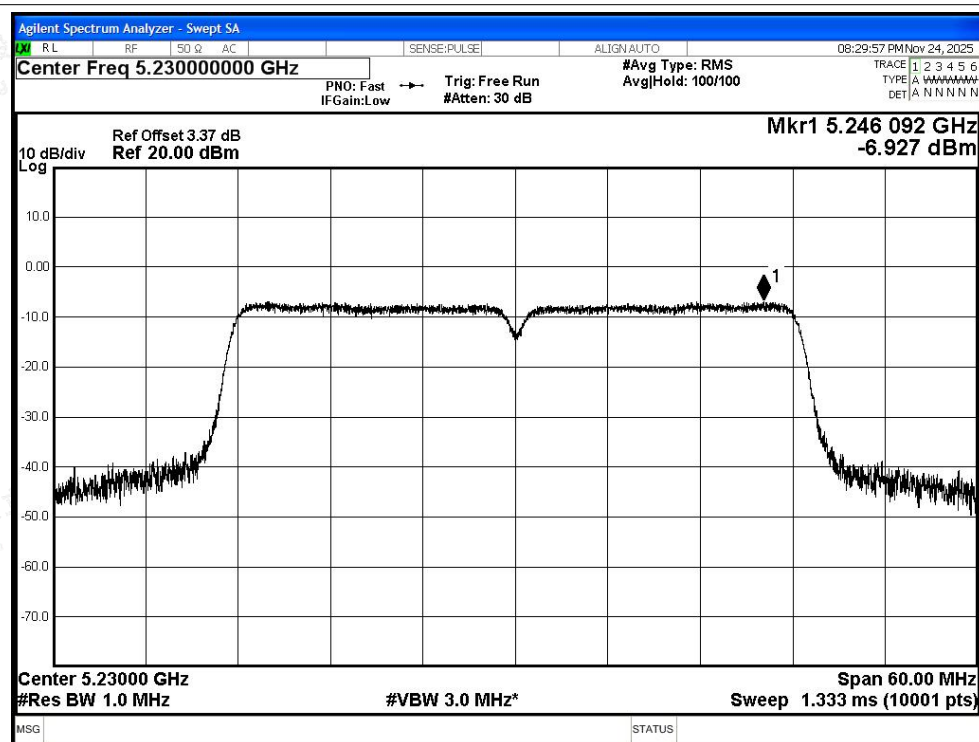

PSD NVNT ax80 5210MHz Ant2

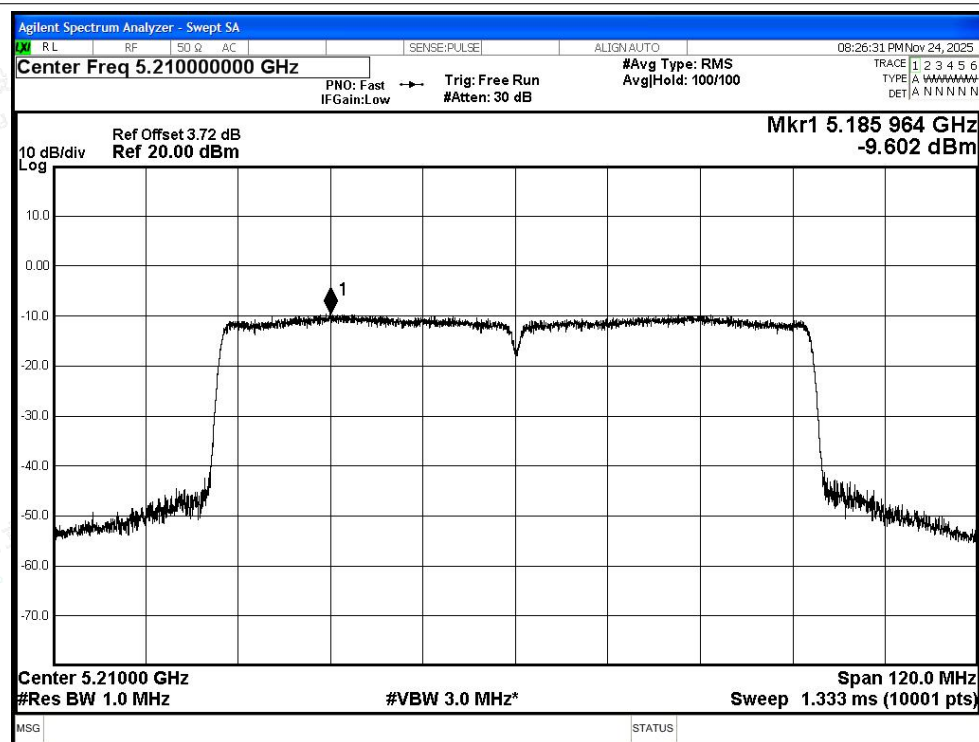

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



D.4 Restrict Band

Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5180	Ant1	4500	-49.62	4.55	-	50.16	Peak	68.2	Pass
NVNT	a	5180	Ant1	4500	-58.1	4.55	0.1	41.78	Average	54	Pass
NVNT	a	5180	Ant1	5149.6	-40.41	4.55	-	59.37	Peak	68.2	Pass
NVNT	a	5180	Ant1	5147.5	-53.13	4.55	0.1	46.75	Average	54	Pass
NVNT	a	5180	Ant1	5150	-40.64	4.55	-	59.14	Peak	68.2	Pass
NVNT	a	5180	Ant1	5150	-52.17	4.55	0.1	47.71	Average	54	Pass
NVNT	a	5240	Ant1	5350	-48.16	4.55	-	51.62	Peak	68.2	Pass
NVNT	a	5240	Ant1	5350	-57.03	4.55	0.1	42.85	Average	54	Pass
NVNT	a	5240	Ant1	5437.68	-45.9	4.55	-	53.88	Peak	68.2	Pass
NVNT	a	5240	Ant1	5364.72	-56.49	4.55	0.1	43.39	Average	54	Pass
NVNT	a	5240	Ant1	5460	-50.11	4.55	-	49.67	Peak	68.2	Pass
NVNT	a	5240	Ant1	5460	-57.23	4.55	0.1	42.65	Average	54	Pass
NVNT	n20	5180	Ant1	4500	-49.65	4.55	-	50.13	Peak	68.2	Pass
NVNT	n20	5180	Ant1	4500	-57.88	4.55	0.12	42.02	Average	54	Pass
NVNT	n20	5180	Ant1	5149.6	-40.65	4.55	-	59.13	Peak	68.2	Pass
NVNT	n20	5180	Ant1	5148.2	-53.09	4.55	0.12	46.81	Average	54	Pass
NVNT	n20	5180	Ant1	5150	-38.45	4.55	-	61.33	Peak	68.2	Pass
NVNT	n20	5180	Ant1	5150	-52.35	4.55	0.12	47.55	Average	54	Pass
NVNT	n20	5240	Ant1	5350	-49.8	4.55	-	49.98	Peak	68.2	Pass
NVNT	n20	5240	Ant1	5350	-57.8	4.55	0.12	42.10	Average	54	Pass
NVNT	n20	5240	Ant1	5395.92	-46.75	4.55	-	53.03	Peak	68.2	Pass
NVNT	n20	5240	Ant1	5417.28	-56.78	4.55	0.12	43.12	Average	54	Pass
NVNT	n20	5240	Ant1	5460	-51.15	4.55	-	48.63	Peak	68.2	Pass
NVNT	n20	5240	Ant1	5460	-57.59	4.55	0.12	42.31	Average	54	Pass
NVNT	n40	5190	Ant1	4500	-51.28	4.55	-	48.50	Peak	68.2	Pass
NVNT	n40	5190	Ant1	4500	-57.79	4.55	0.23	42.22	Average	54	Pass
NVNT	n40	5190	Ant1	5147.51	-40.81	4.55	-	58.97	Peak	68.2	Pass
NVNT	n40	5190	Ant1	5149.7	-53.65	4.55	0.23	46.36	Average	54	Pass
NVNT	n40	5190	Ant1	5150	-42.63	4.55	-	57.15	Peak	68.2	Pass
NVNT	n40	5190	Ant1	5150	-53.65	4.55	0.23	46.36	Average	54	Pass
NVNT	n40	5230	Ant1	5350	-49.26	4.55	-	50.52	Peak	68.2	Pass
NVNT	n40	5230	Ant1	5350	-57.05	4.55	0.23	42.96	Average	54	Pass
NVNT	n40	5230	Ant1	5414.1	-45.31	4.55	-	54.47	Peak	68.2	Pass
NVNT	n40	5230	Ant1	5367.39	-56.63	4.55	0.23	43.38	Average	54	Pass
NVNT	n40	5230	Ant1	5460	-50.36	4.55	-	49.42	Peak	68.2	Pass
NVNT	n40	5230	Ant1	5460	-57.33	4.55	0.23	42.68	Average	54	Pass
NVNT	ac20	5180	Ant1	4500	-50.12	4.55	-	49.66	Peak	68.2	Pass
NVNT	ac20	5180	Ant1	4500	-59.06	4.55	0.12	40.84	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5180	Ant1	5148.2	-39.02	4.55	-	60.76	Peak	68.2	Pass
NVNT	ac20	5180	Ant1	5149.6	-52.37	4.55	0.12	47.53	Average	54	Pass
NVNT	ac20	5180	Ant1	5150	-42.37	4.55	-	57.41	Peak	68.2	Pass
NVNT	ac20	5180	Ant1	5150	-50.84	4.55	0.12	49.06	Average	54	Pass
NVNT	ac20	5240	Ant1	5350	-49.78	4.55	-	50.00	Peak	68.2	Pass
NVNT	ac20	5240	Ant1	5350	-58.07	4.55	0.12	41.83	Average	54	Pass
NVNT	ac20	5240	Ant1	5437.44	-46.32	4.55	-	53.46	Peak	68.2	Pass
NVNT	ac20	5240	Ant1	5351.04	-56.86	4.55	0.12	43.04	Average	54	Pass
NVNT	ac20	5240	Ant1	5460	-50.41	4.55	-	49.37	Peak	68.2	Pass
NVNT	ac20	5240	Ant1	5460	-57.33	4.55	0.12	42.57	Average	54	Pass
NVNT	ac40	5190	Ant1	4500	-50.67	4.55	-	49.11	Peak	68.2	Pass
NVNT	ac40	5190	Ant1	4500	-58.09	4.55	0.24	41.93	Average	54	Pass
NVNT	ac40	5190	Ant1	5149.7	-41.48	4.55	-	58.30	Peak	68.2	Pass
NVNT	ac40	5190	Ant1	5149.7	-52.73	4.55	0.24	47.29	Average	54	Pass
NVNT	ac40	5190	Ant1	5150	-41.48	4.55	-	58.30	Peak	68.2	Pass
NVNT	ac40	5190	Ant1	5150	-52.73	4.55	0.24	47.29	Average	54	Pass
NVNT	ac40	5230	Ant1	5350	-50.17	4.55	-	49.61	Peak	68.2	Pass
NVNT	ac40	5230	Ant1	5350	-57.44	4.55	0.23	42.57	Average	54	Pass
NVNT	ac40	5230	Ant1	5373.87	-46.82	4.55	-	52.96	Peak	68.2	Pass
NVNT	ac40	5230	Ant1	5400.33	-56.94	4.55	0.23	43.07	Average	54	Pass
NVNT	ac40	5230	Ant1	5460	-48.04	4.55	-	51.74	Peak	68.2	Pass
NVNT	ac40	5230	Ant1	5460	-57.78	4.55	0.23	42.23	Average	54	Pass
NVNT	ac80	5210	Ant1	5350	-47.33	4.55	-	52.45	Peak	68.2	Pass
NVNT	ac80	5210	Ant1	5350	-57.03	4.55	0.47	43.22	Average	54	Pass
NVNT	ac80	5210	Ant1	5429.97	-46.18	4.55	-	53.60	Peak	68.2	Pass
NVNT	ac80	5210	Ant1	5375.85	-56.46	4.55	0.47	43.79	Average	54	Pass
NVNT	ac80	5210	Ant1	5460	-48.6	4.55	-	51.18	Peak	68.2	Pass
NVNT	ac80	5210	Ant1	5460	-56.84	4.55	0.47	43.41	Average	54	Pass
NVNT	ac80	5210	Ant1	4500	-49.99	4.55	-	49.79	Peak	68.2	Pass
NVNT	ac80	5210	Ant1	4500	-57.76	4.55	0.47	42.49	Average	54	Pass
NVNT	ac80	5210	Ant1	5147.01	-40.01	4.55	-	59.77	Peak	68.2	Pass
NVNT	ac80	5210	Ant1	5148.59	-52.69	4.55	0.47	47.56	Average	54	Pass
NVNT	ac80	5210	Ant1	5150	-39.96	4.55	-	59.82	Peak	68.2	Pass
NVNT	ac80	5210	Ant1	5150	-52.44	4.55	0.47	47.81	Average	54	Pass
NVNT	ax20	5180	Ant1	4500	-50.23	4.55	-	49.55	Peak	68.2	Pass
NVNT	ax20	5180	Ant1	4500	-58.19	4.55	0.12	41.71	Average	54	Pass
NVNT	ax20	5180	Ant1	5148.9	-34.89	4.55	-	64.89	Peak	68.2	Pass
NVNT	ax20	5180	Ant1	5149.6	-52.65	4.55	0.12	47.25	Average	54	Pass
NVNT	ax20	5180	Ant1	5150	-41.35	4.55	-	58.43	Peak	68.2	Pass
NVNT	ax20	5180	Ant1	5150	-52.31	4.55	0.12	47.59	Average	54	Pass
NVNT	ax20	5240	Ant1	5350	-48.54	4.55	-	51.24	Peak	68.2	Pass
NVNT	ax20	5240	Ant1	5350	-57.56	4.55	0.12	42.34	Average	54	Pass
NVNT	ax20	5240	Ant1	5375.52	-46.68	4.55	-	53.10	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax20	5240	Ant1	5385.36	-56.7	4.55	0.12	43.20	Average	54	Pass
NVNT	ax20	5240	Ant1	5460	-50.16	4.55	-	49.62	Peak	68.2	Pass
NVNT	ax20	5240	Ant1	5460	-57.15	4.55	0.12	42.75	Average	54	Pass
NVNT	ax40	5190	Ant1	4500	-51	4.55	-	48.78	Peak	68.2	Pass
NVNT	ax40	5190	Ant1	4500	-57.53	4.55	0.24	42.49	Average	54	Pass
NVNT	ax40	5190	Ant1	5148.24	-38.99	4.55	-	60.79	Peak	68.2	Pass
NVNT	ax40	5190	Ant1	5149.7	-52.81	4.55	0.24	47.21	Average	54	Pass
NVNT	ax40	5190	Ant1	5150	-43.38	4.55	-	56.40	Peak	68.2	Pass
NVNT	ax40	5190	Ant1	5150	-52.81	4.55	0.24	47.21	Average	54	Pass
NVNT	ax40	5230	Ant1	5350	-47.89	4.55	-	51.89	Peak	68.2	Pass
NVNT	ax40	5230	Ant1	5350	-57.13	4.55	0.23	42.88	Average	54	Pass
NVNT	ax40	5230	Ant1	5423.82	-46.4	4.55	-	53.38	Peak	68.2	Pass
NVNT	ax40	5230	Ant1	5384.94	-56.82	4.55	0.23	43.19	Average	54	Pass
NVNT	ax40	5230	Ant1	5460	-48.82	4.55	-	50.96	Peak	68.2	Pass
NVNT	ax40	5230	Ant1	5460	-57.5	4.55	0.23	42.51	Average	54	Pass
NVNT	ax80	5210	Ant1	5350	-49.84	4.55	-	49.94	Peak	68.2	Pass
NVNT	ax80	5210	Ant1	5350	-56.84	4.55	0.47	43.41	Average	54	Pass
NVNT	ax80	5210	Ant1	5437.89	-46.35	4.55	-	53.43	Peak	68.2	Pass
NVNT	ax80	5210	Ant1	5381.46	-56.26	4.55	0.47	43.99	Average	54	Pass
NVNT	ax80	5210	Ant1	5460	-49.28	4.55	-	50.50	Peak	68.2	Pass
NVNT	ax80	5210	Ant1	5460	-57.4	4.55	0.47	42.85	Average	54	Pass
NVNT	ax80	5210	Ant1	4500	-48.83	4.55	-	50.95	Peak	68.2	Pass
NVNT	ax80	5210	Ant1	4500	-58.55	4.55	0.47	41.70	Average	54	Pass
NVNT	ax80	5210	Ant1	5148.59	-41.72	4.55	-	58.06	Peak	68.2	Pass
NVNT	ax80	5210	Ant1	5149.38	-52.97	4.55	0.47	47.28	Average	54	Pass
NVNT	ax80	5210	Ant1	5150	-40.73	4.55	-	59.05	Peak	68.2	Pass
NVNT	ax80	5210	Ant1	5150	-52.82	4.55	0.47	47.43	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Restrict Band NVNT a 5180MHz Ant1 Peak

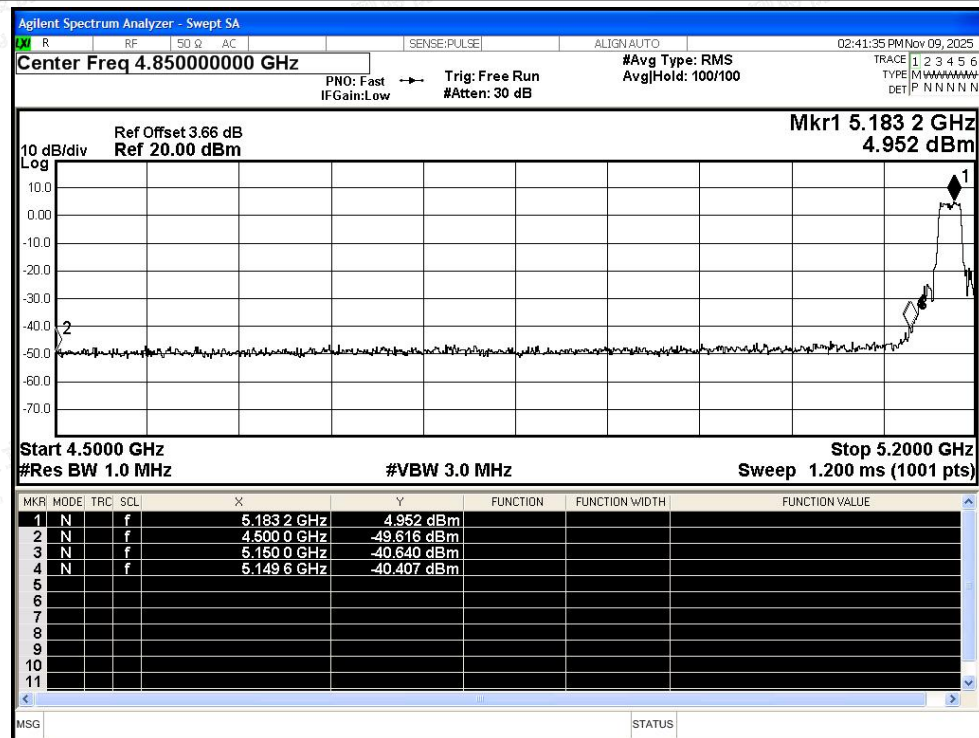

Restrict Band NVNT a 5180MHz Ant1 Average

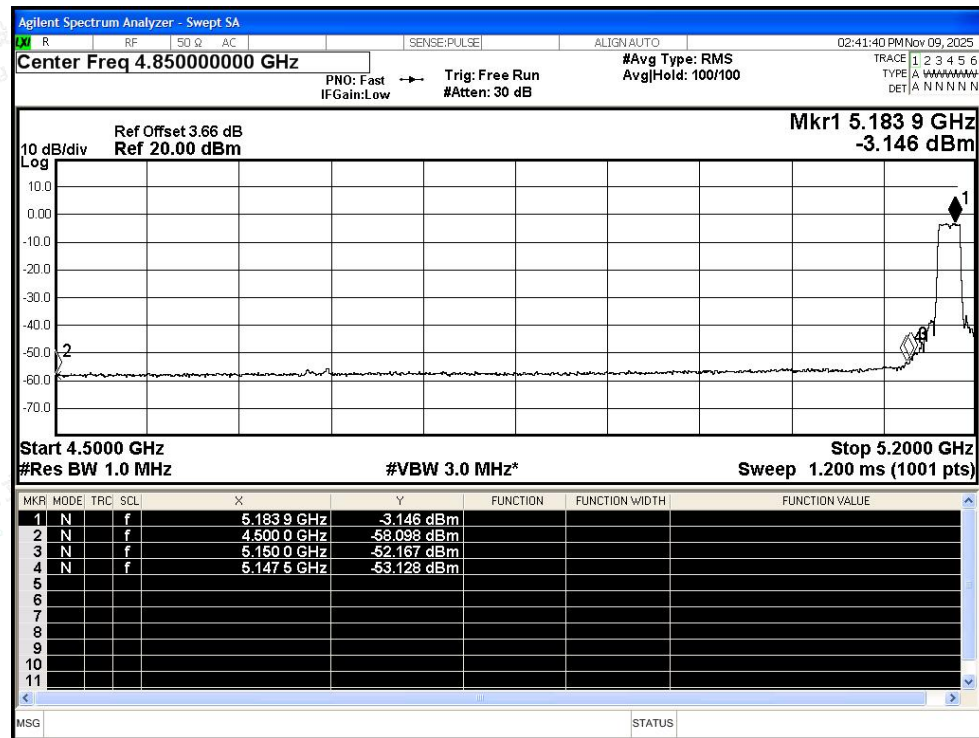

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5240MHz Ant1 Peak

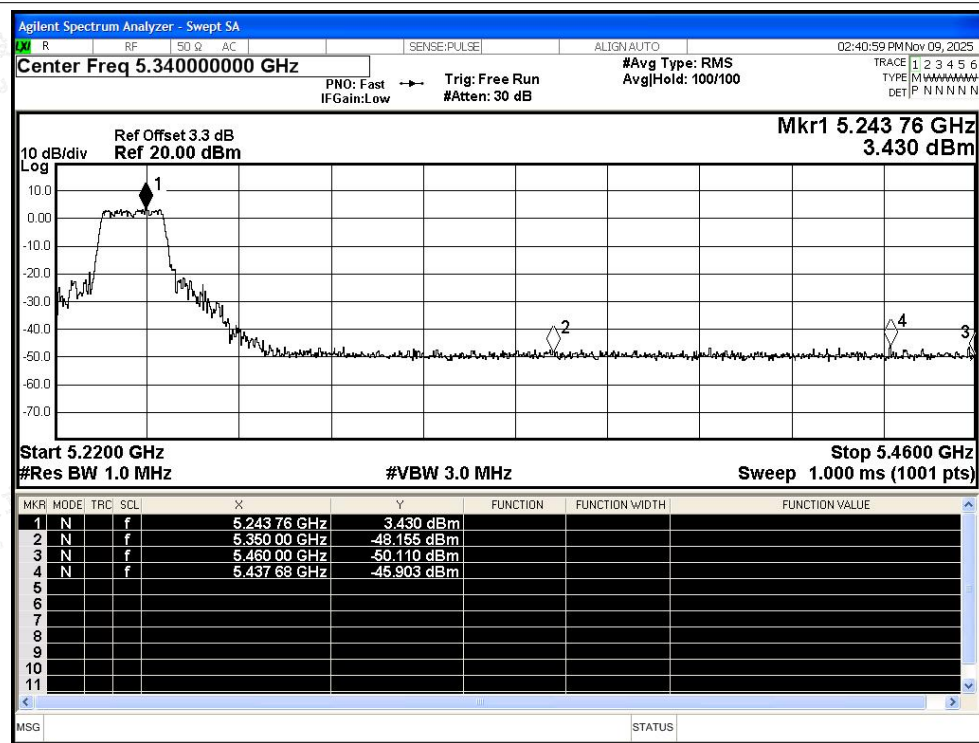

Restrict Band NVNT a 5240MHz Ant1 Average

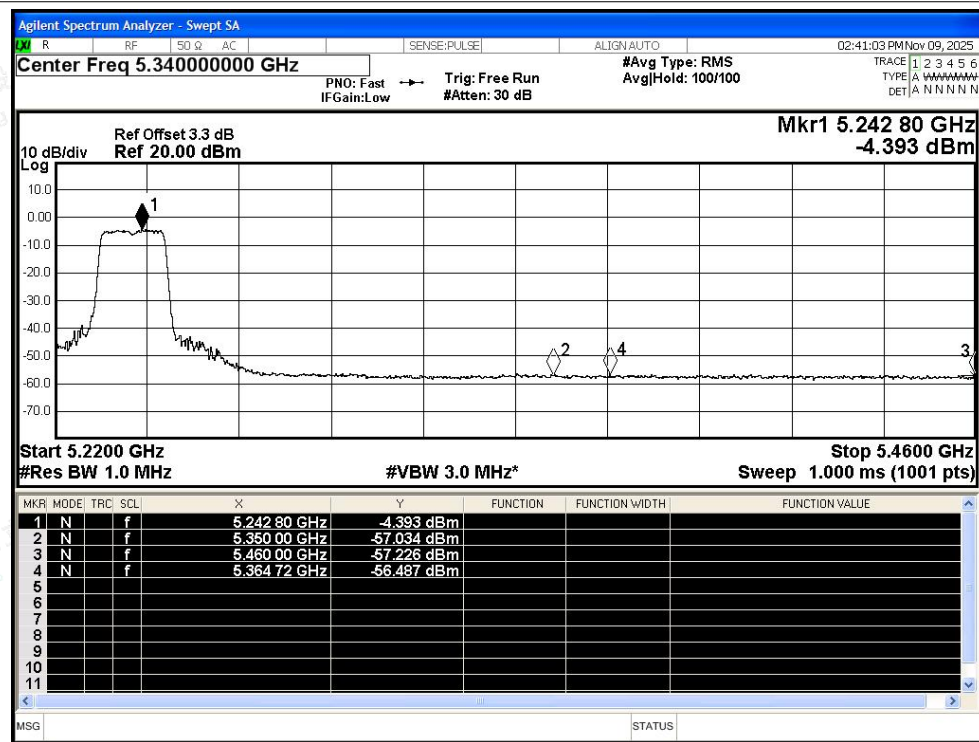

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5180MHz Ant1 Peak

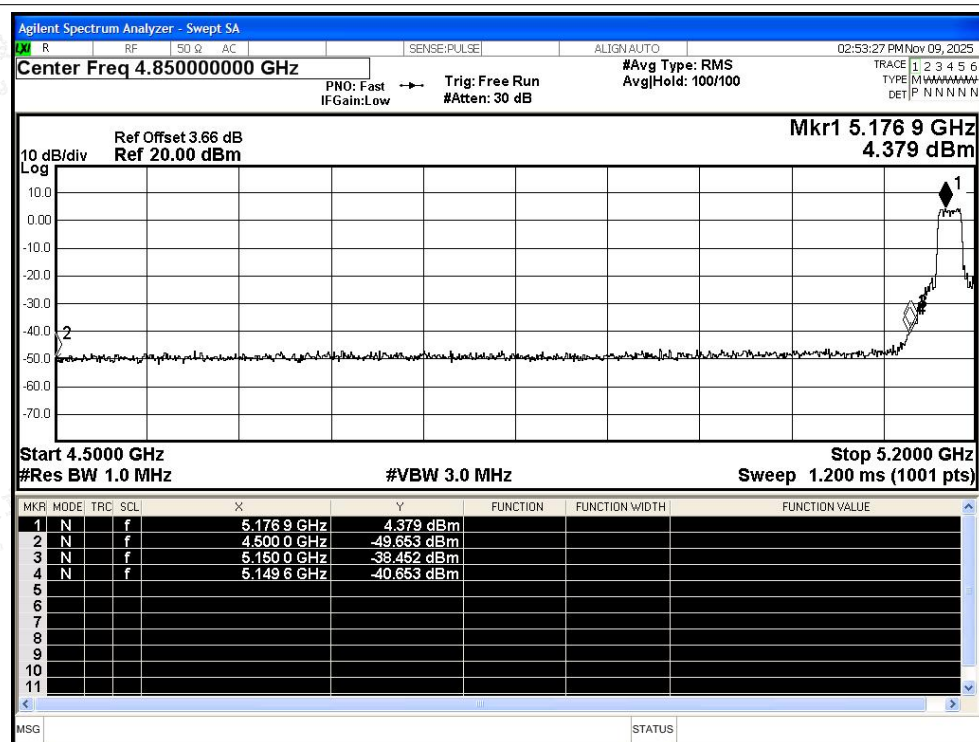

Restrict Band NVNT n20 5180MHz Ant1 Average

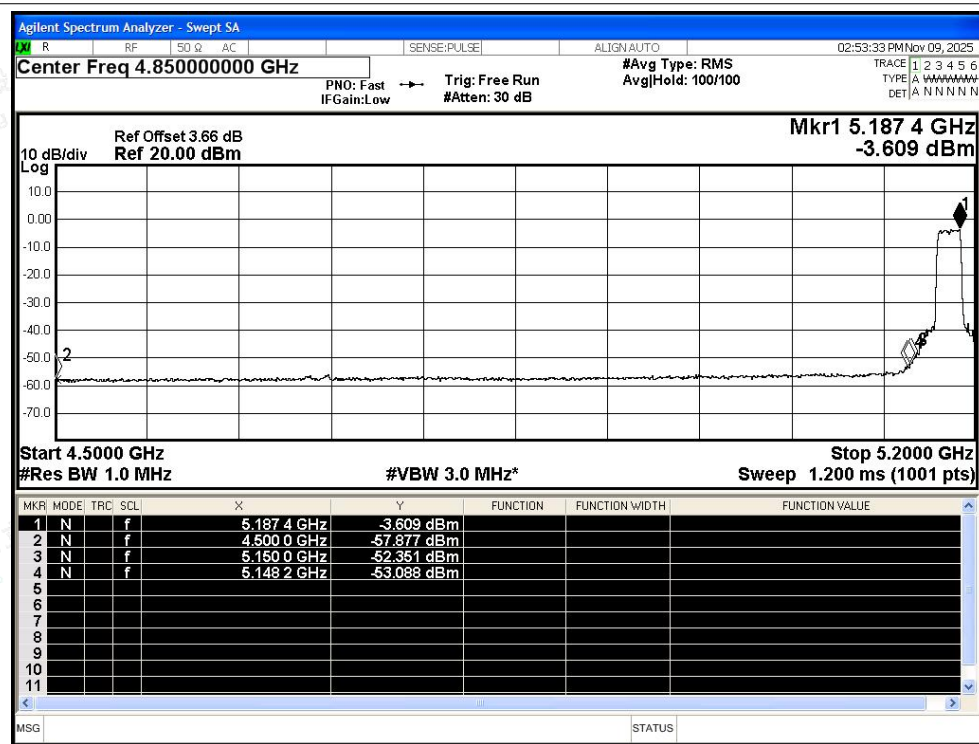

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5240MHz Ant1 Peak

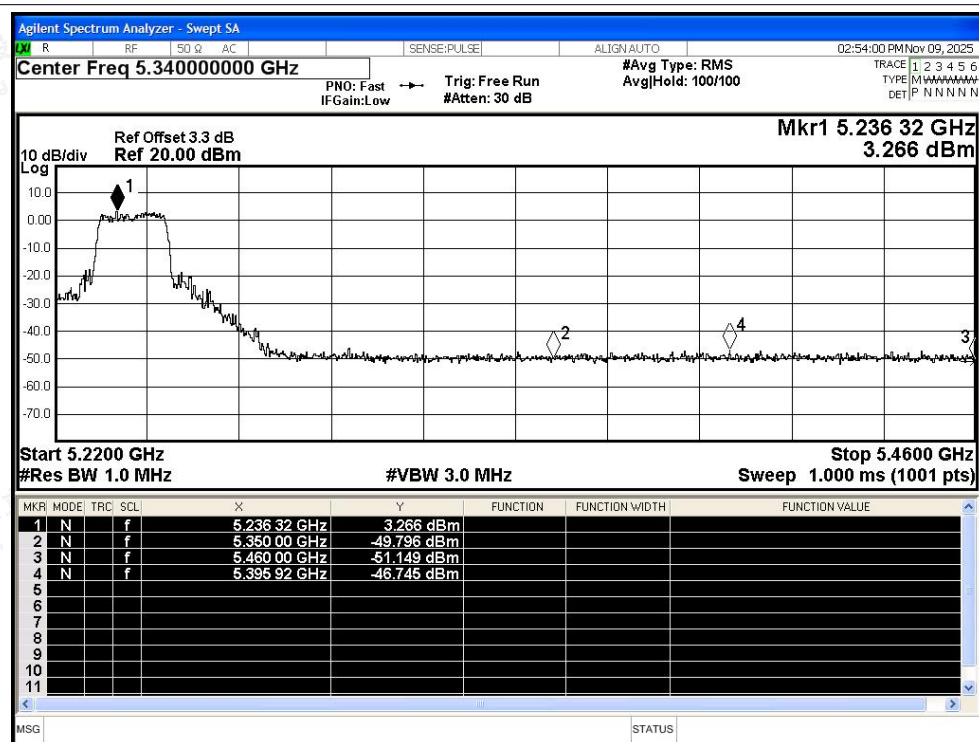

Restrict Band NVNT n20 5240MHz Ant1 Average

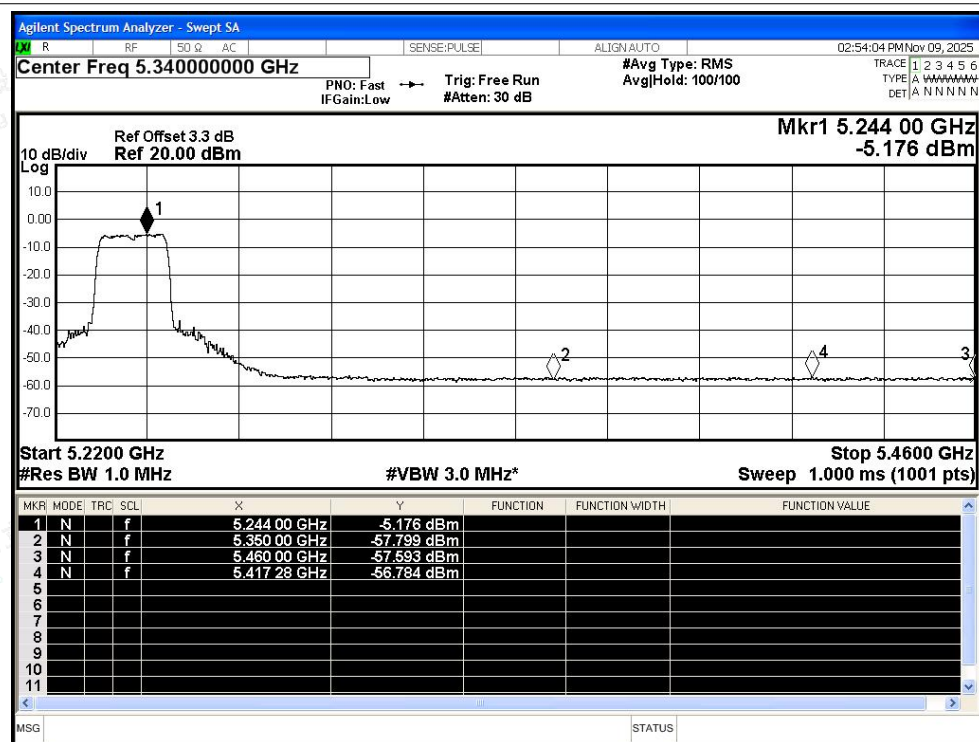

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity