





Restrict Band NVNT n40 5190MHz Ant1 Peak

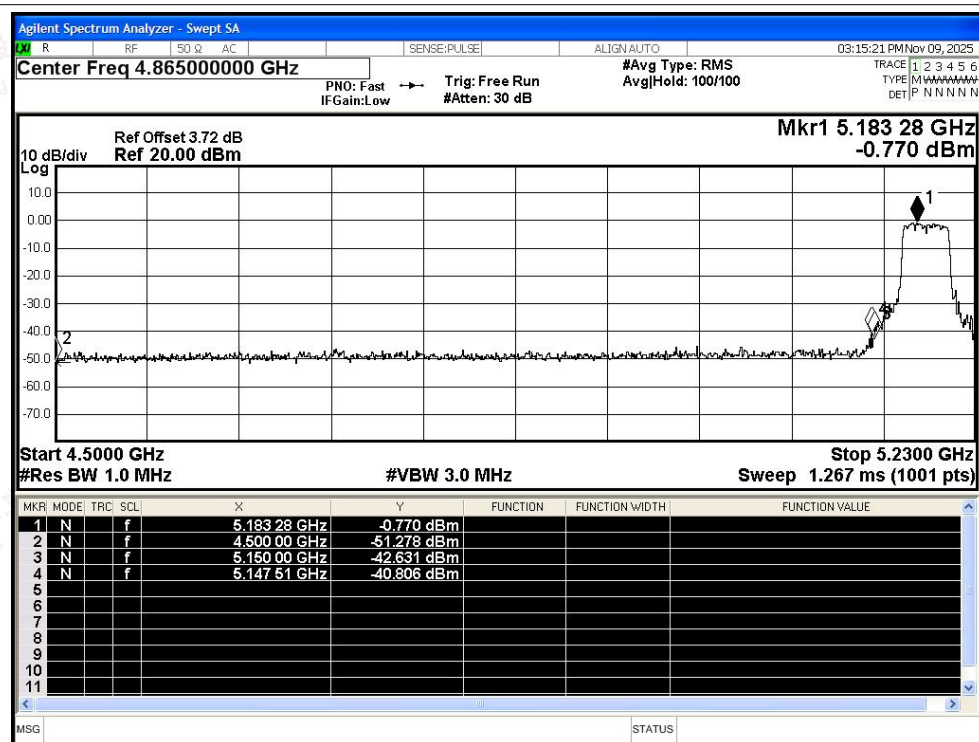

Restrict Band NVNT n40 5190MHz Ant1 Average

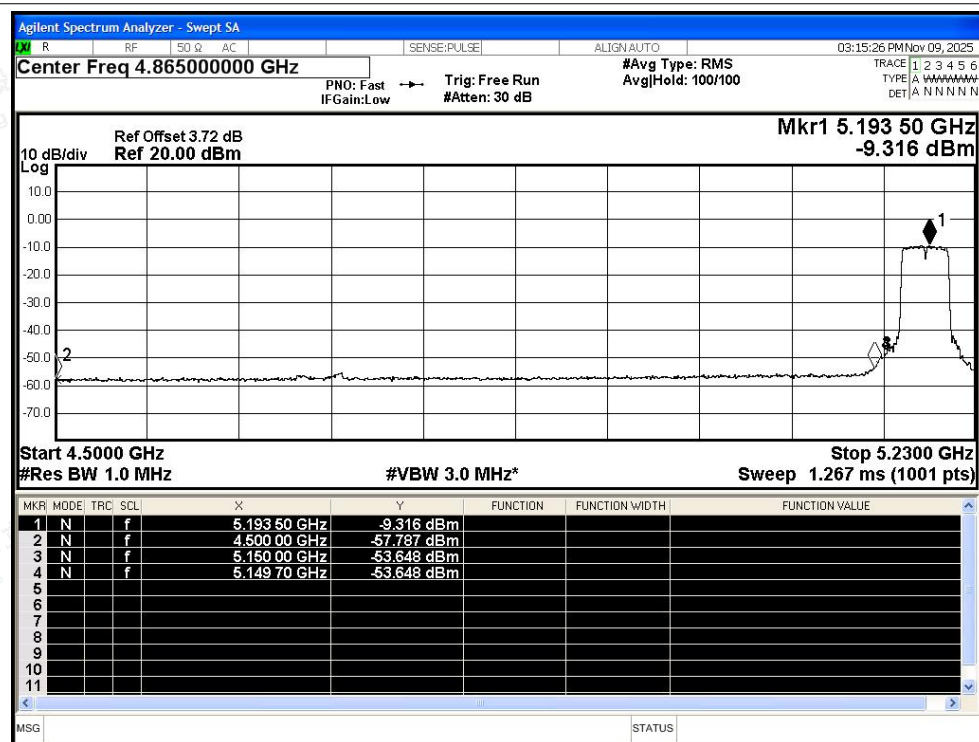

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5230MHz Ant1 Peak

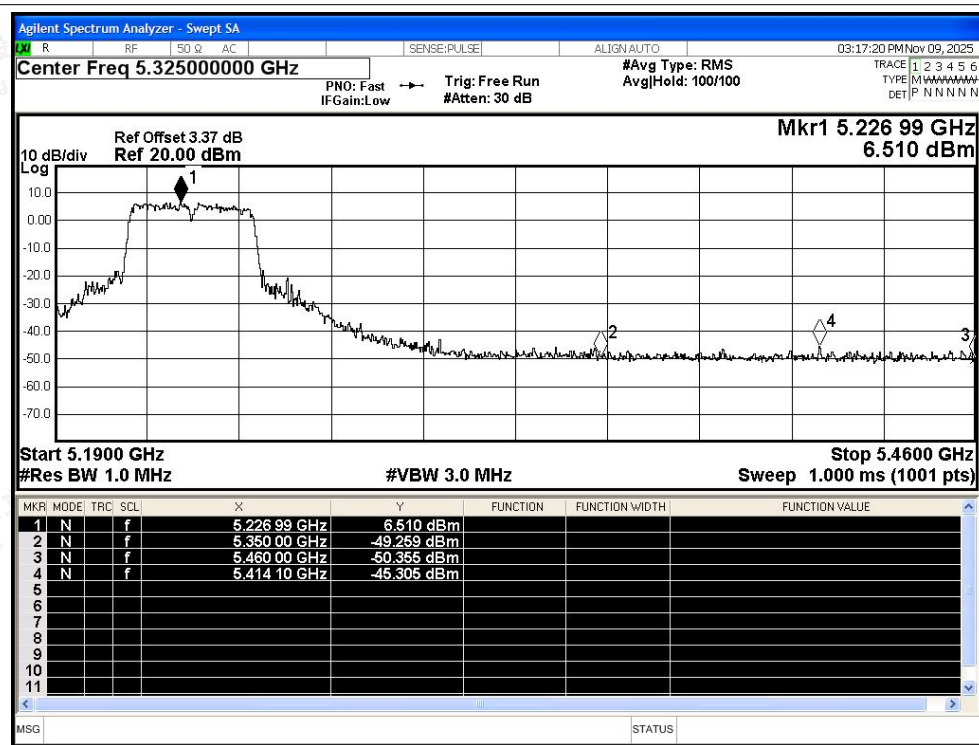

Restrict Band NVNT n40 5230MHz Ant1 Average

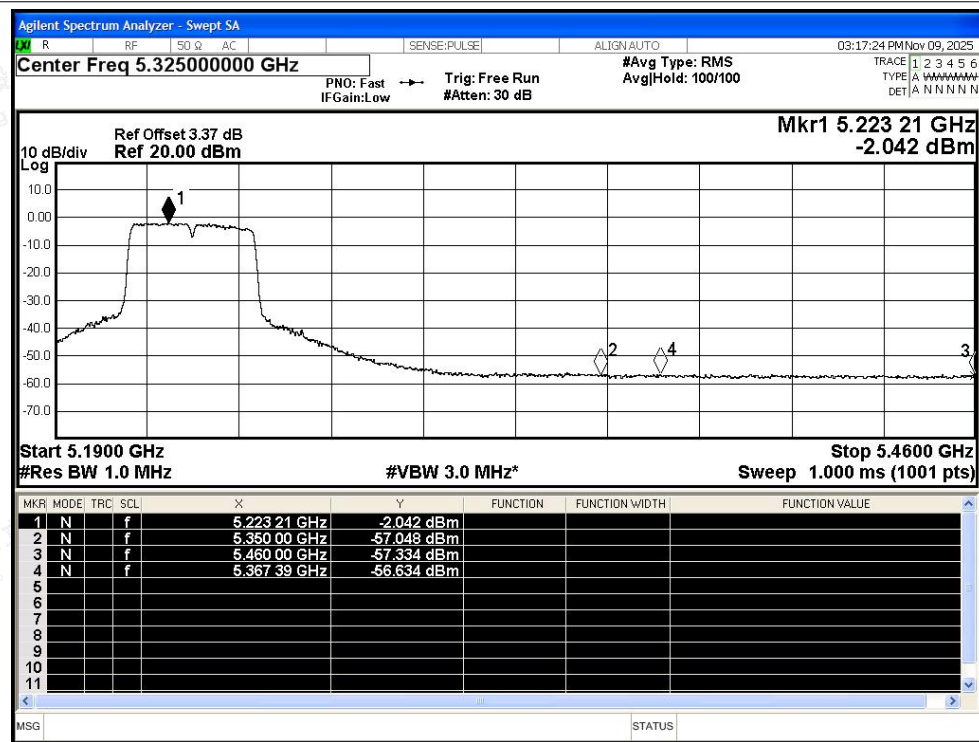

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5180MHz Ant1 Peak

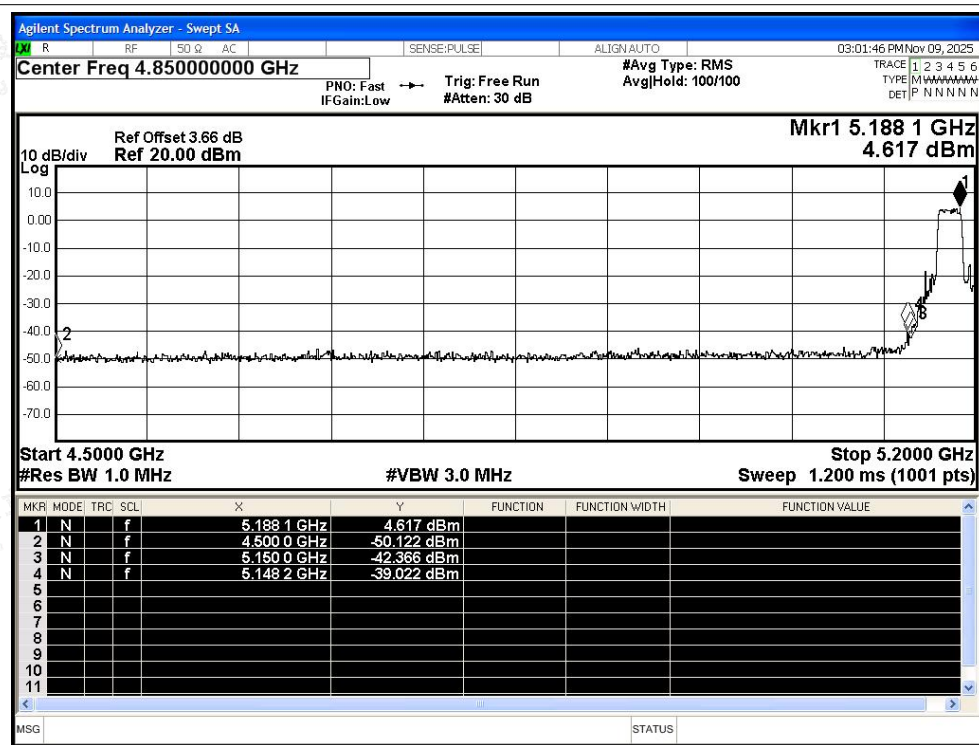

Restrict Band NVNT ac20 5180MHz Ant1 Average

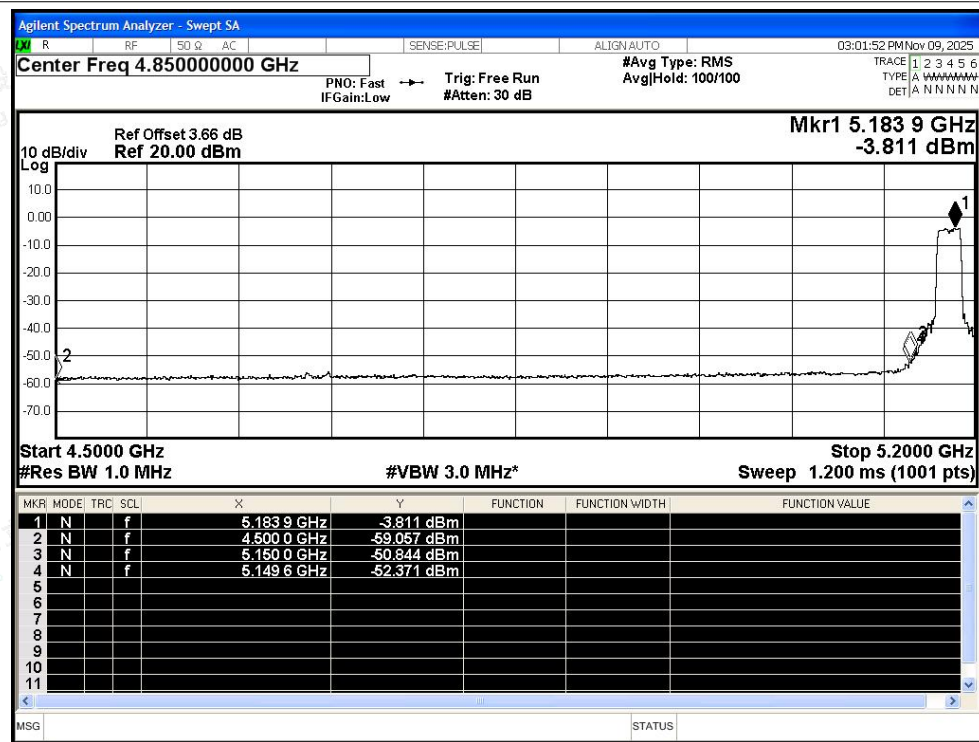

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5240MHz Ant1 Peak

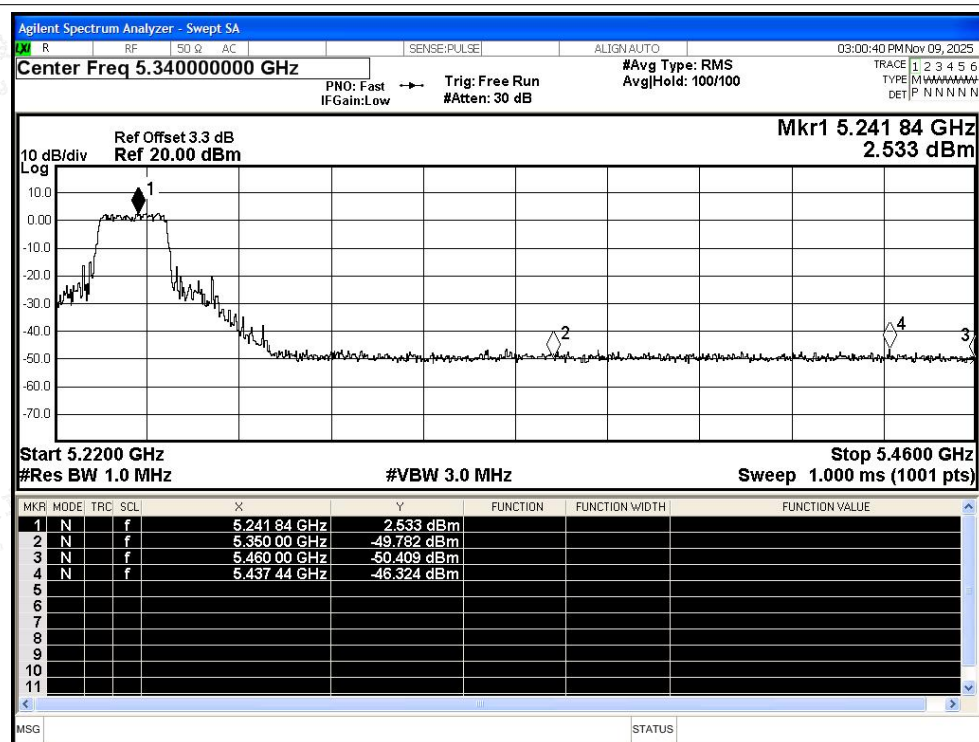

Restrict Band NVNT ac20 5240MHz Ant1 Average

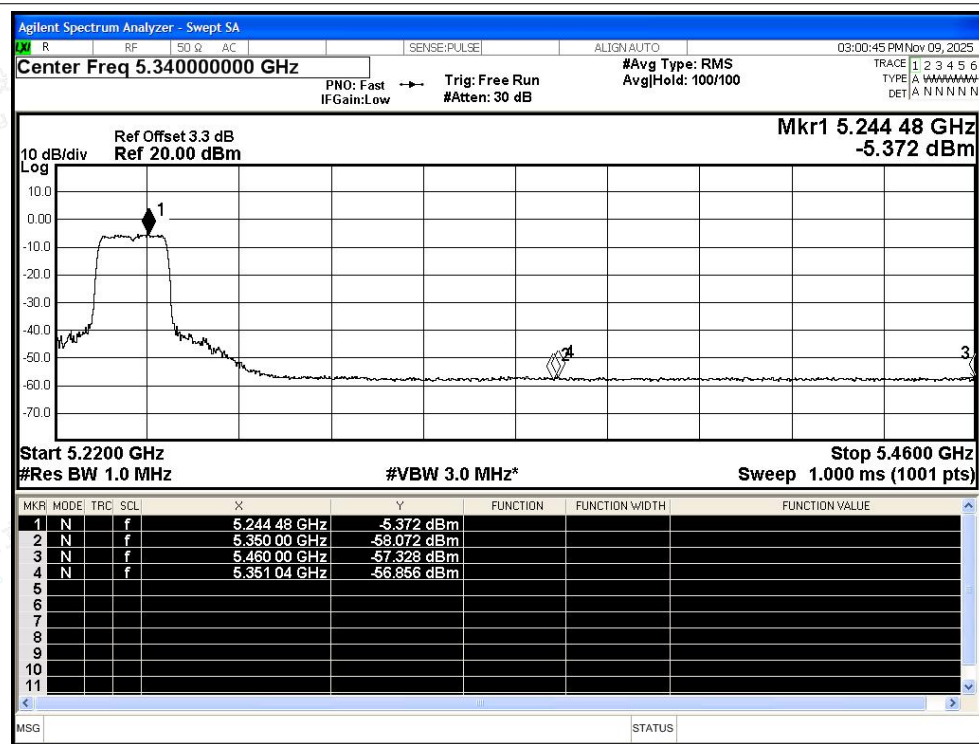

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5190MHz Ant1 Peak

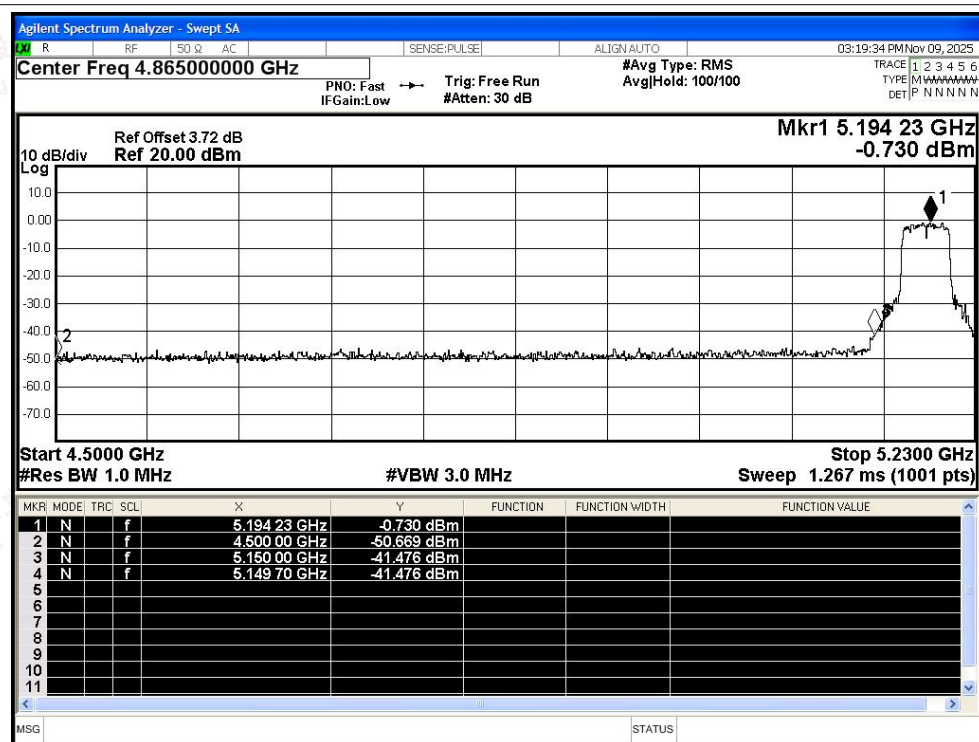

Restrict Band NVNT ac40 5190MHz Ant1 Average

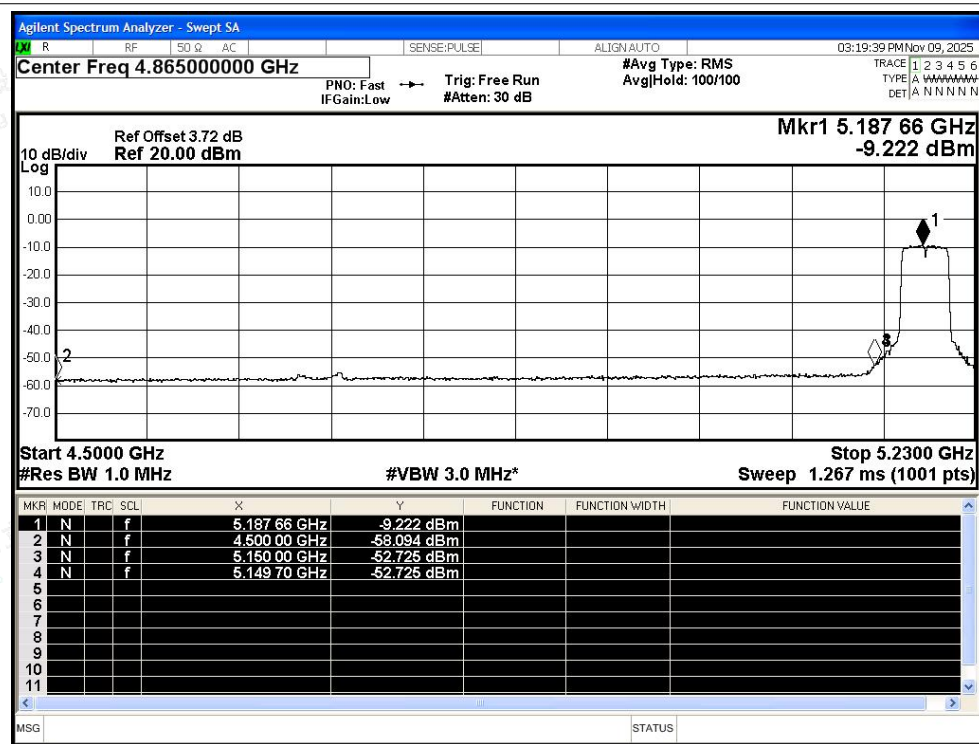

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5230MHz Ant1 Peak

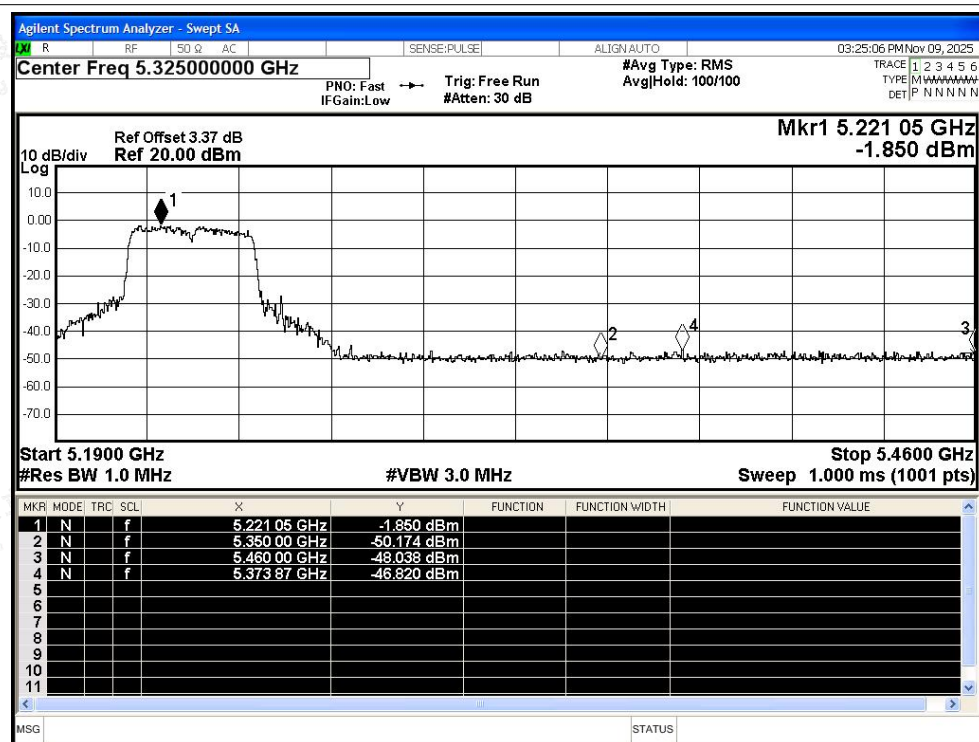

Restrict Band NVNT ac40 5230MHz Ant1 Average

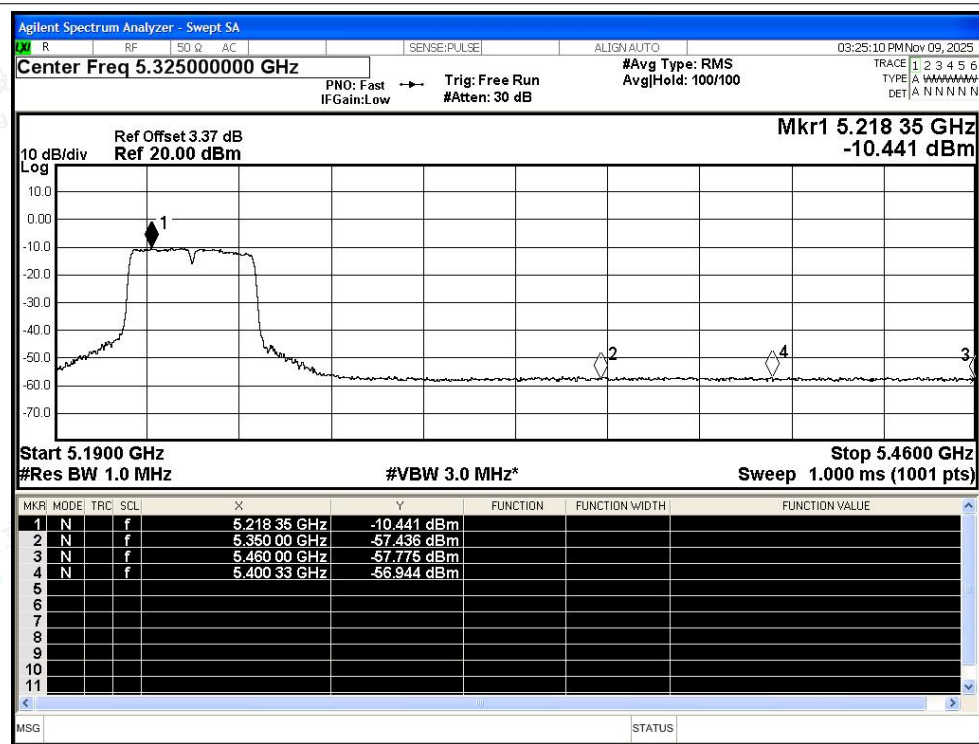

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5210MHz Ant1 Peak

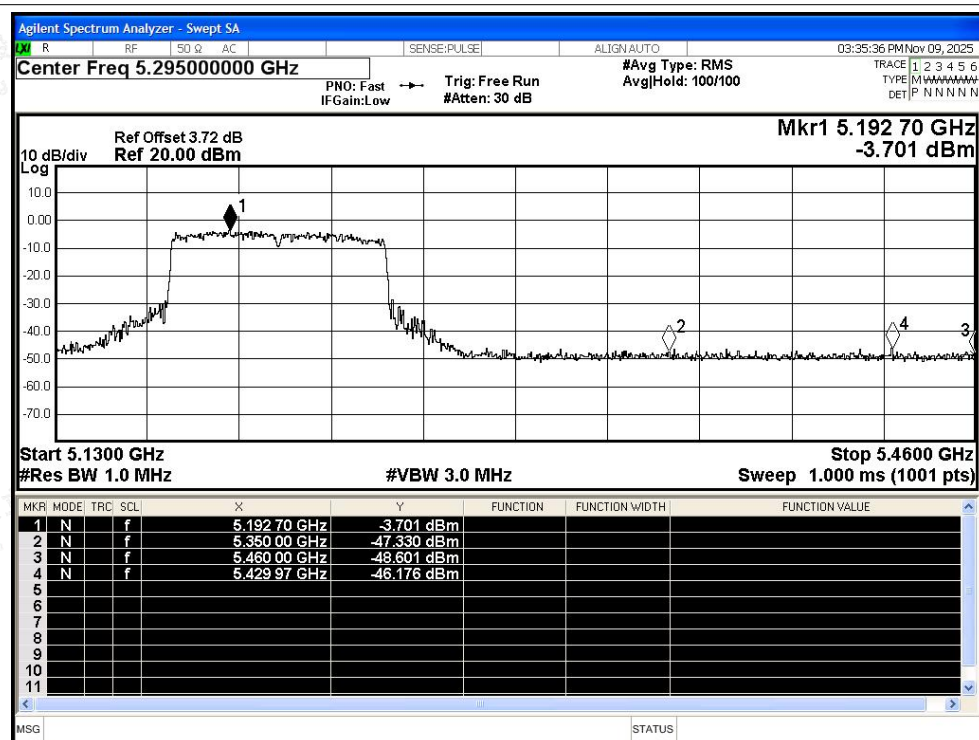

Restrict Band NVNT ac80 5210MHz Ant1 Average

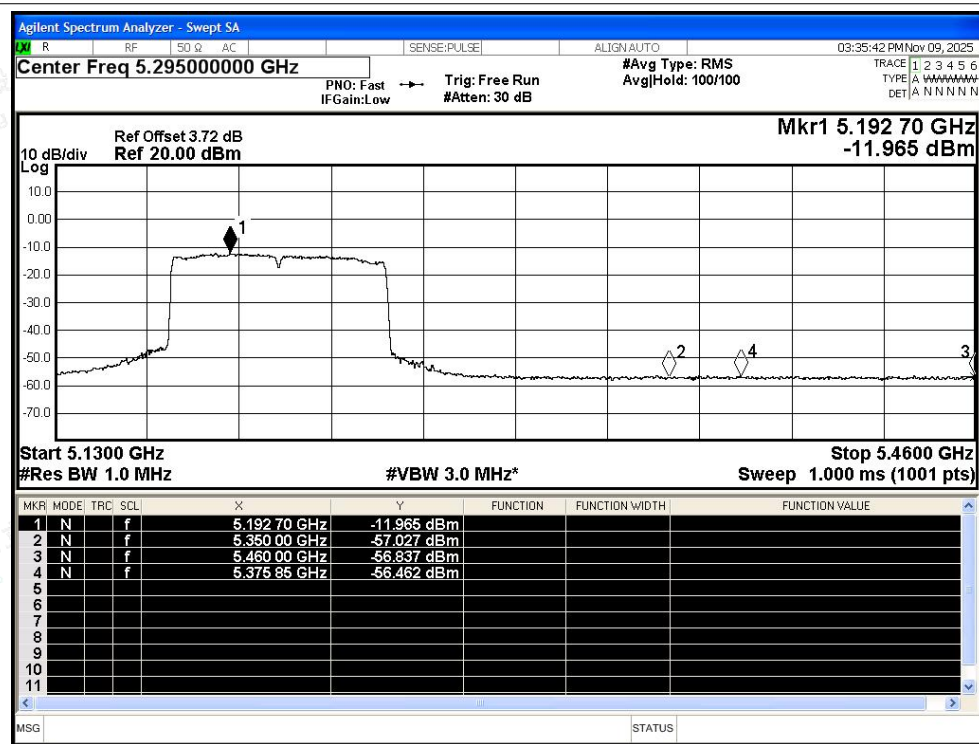

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5210MHz Ant1 Peak

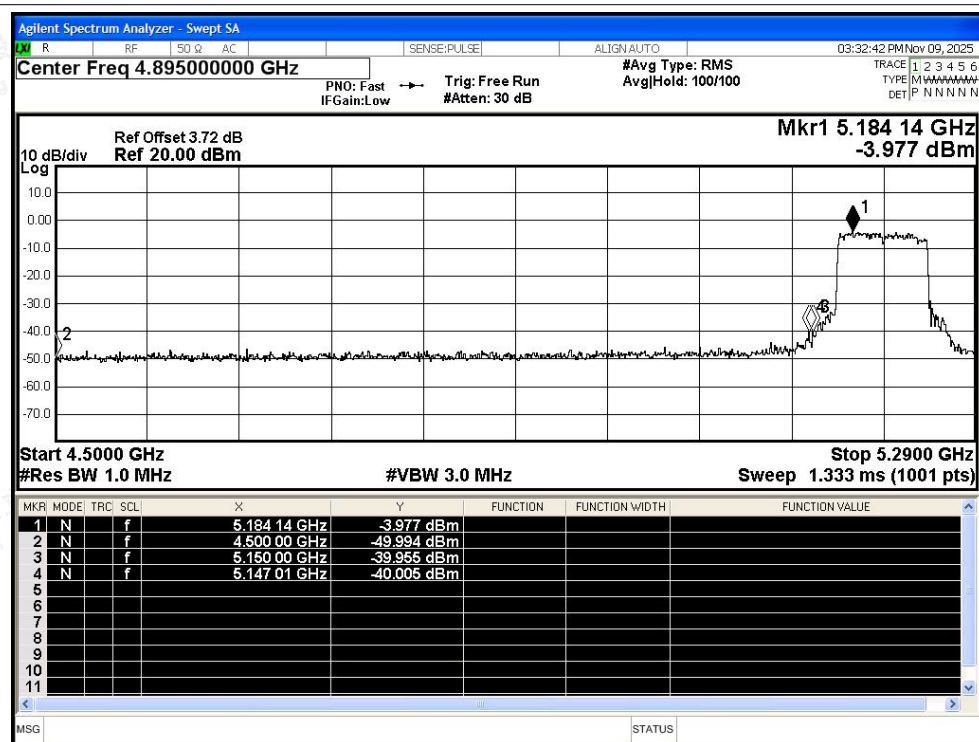

Restrict Band NVNT ac80 5210MHz Ant1 Average

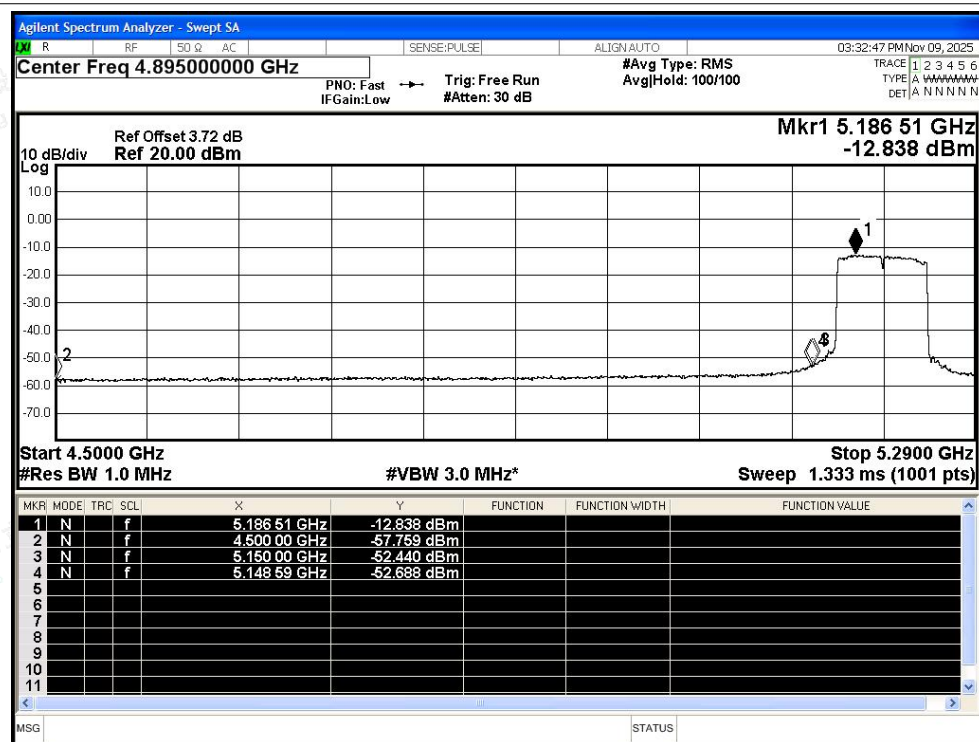

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5180MHz Ant1 Peak

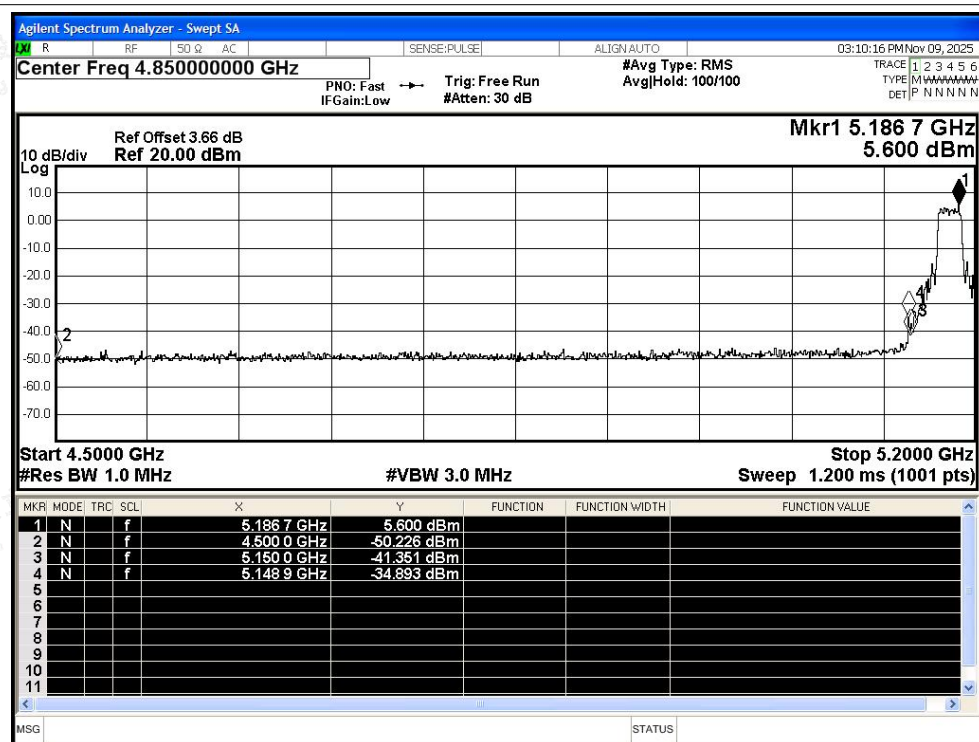

Restrict Band NVNT ax20 5180MHz Ant1 Average

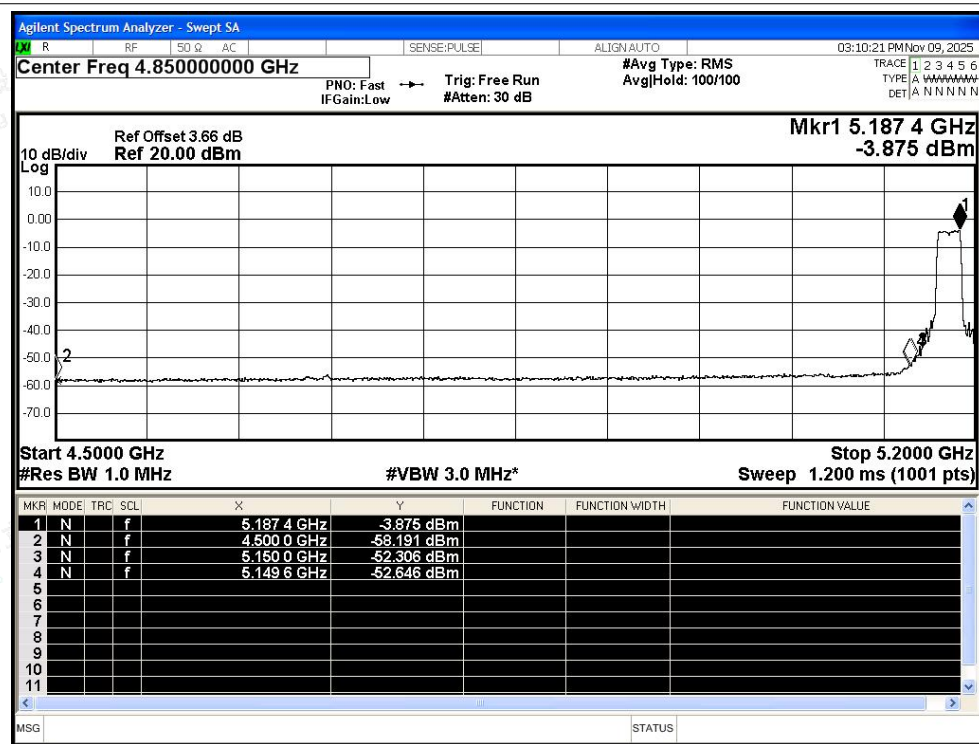

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5240MHz Ant1 Peak

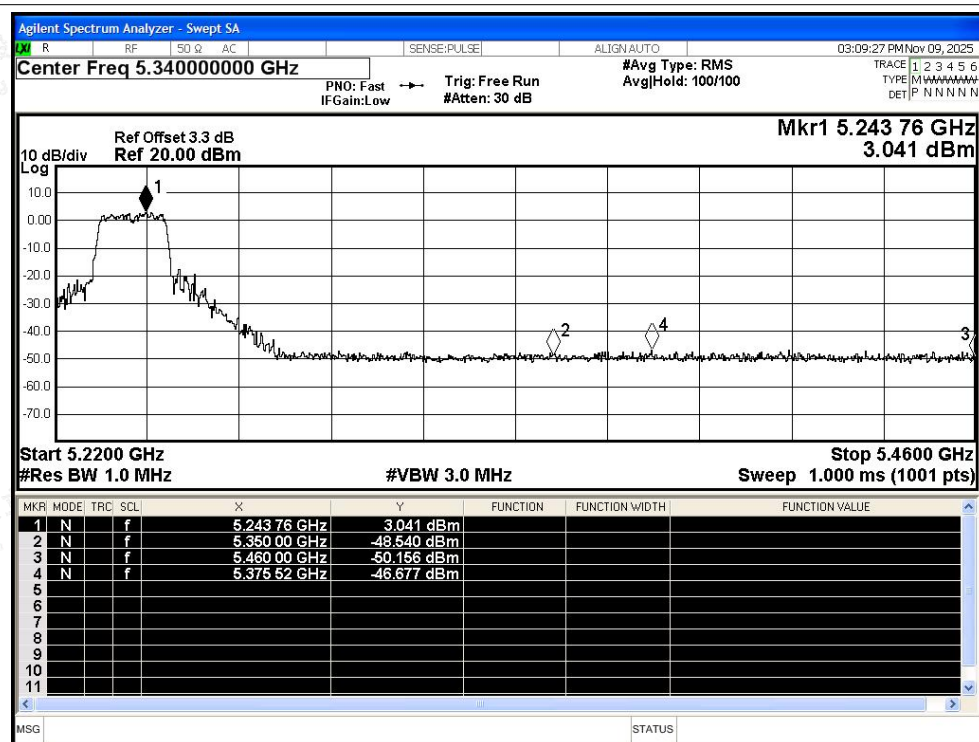

Restrict Band NVNT ax20 5240MHz Ant1 Average

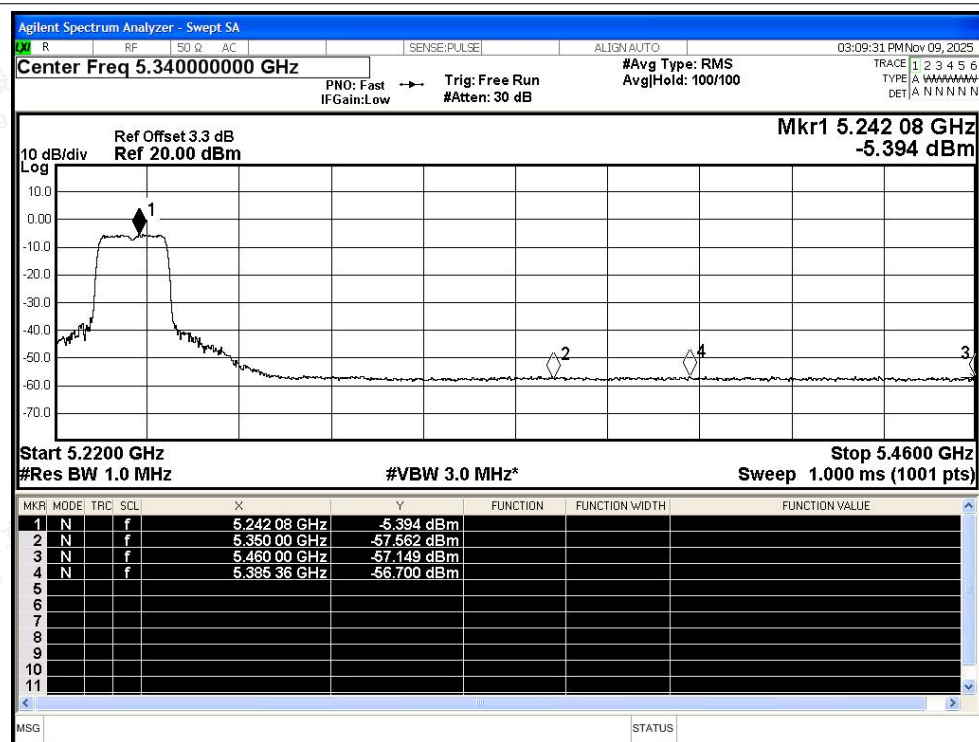

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5190MHz Ant1 Peak

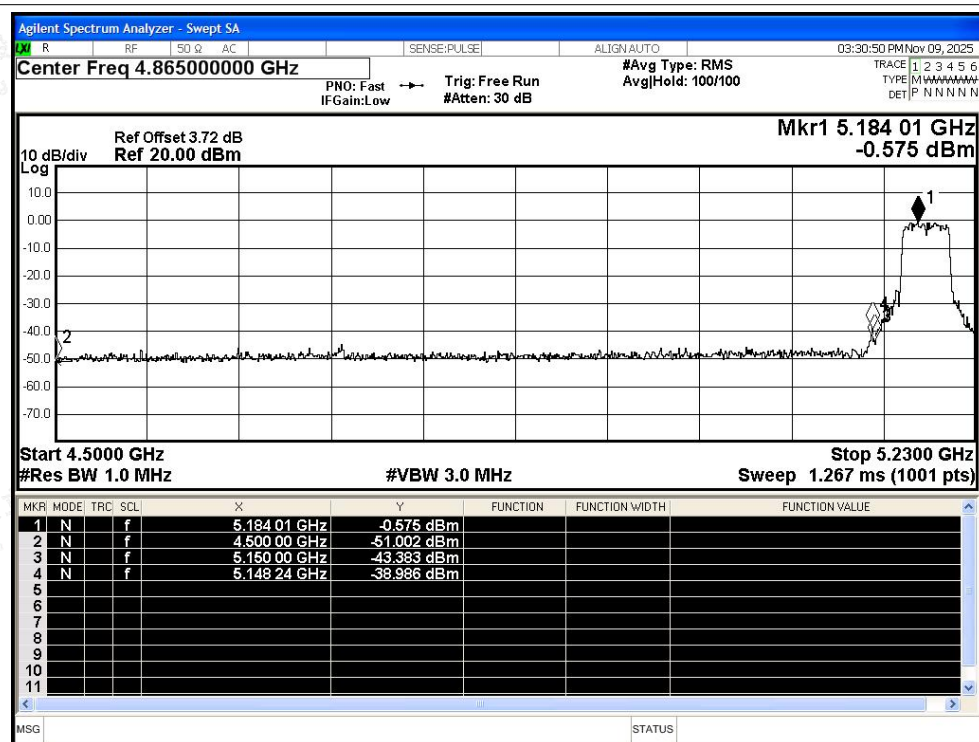

Restrict Band NVNT ax40 5190MHz Ant1 Average

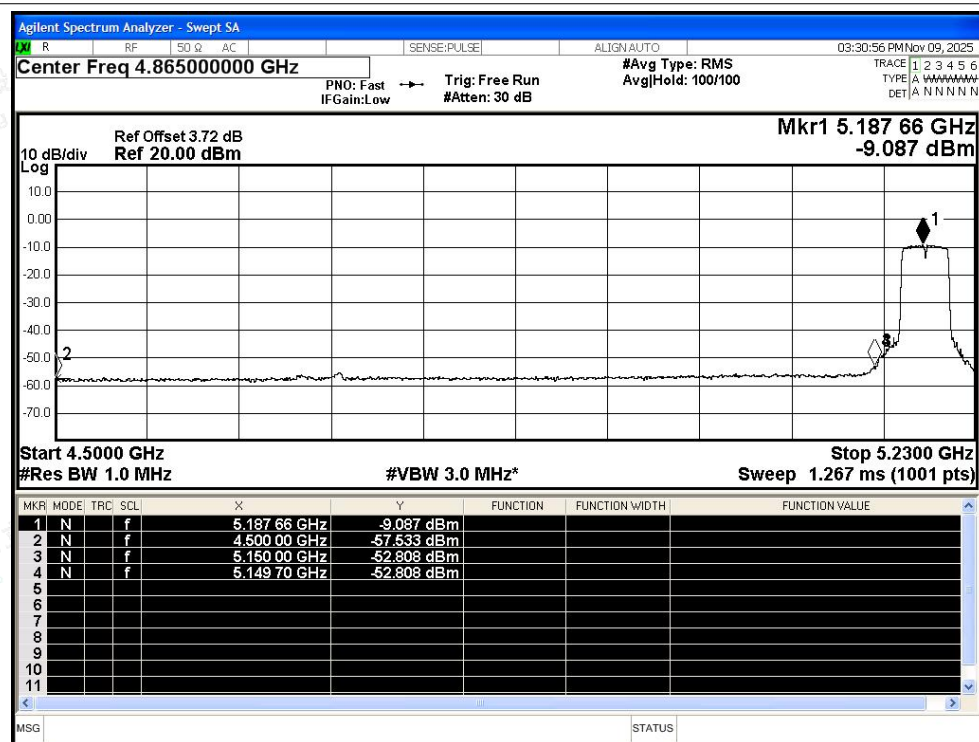

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5230MHz Ant1 Peak

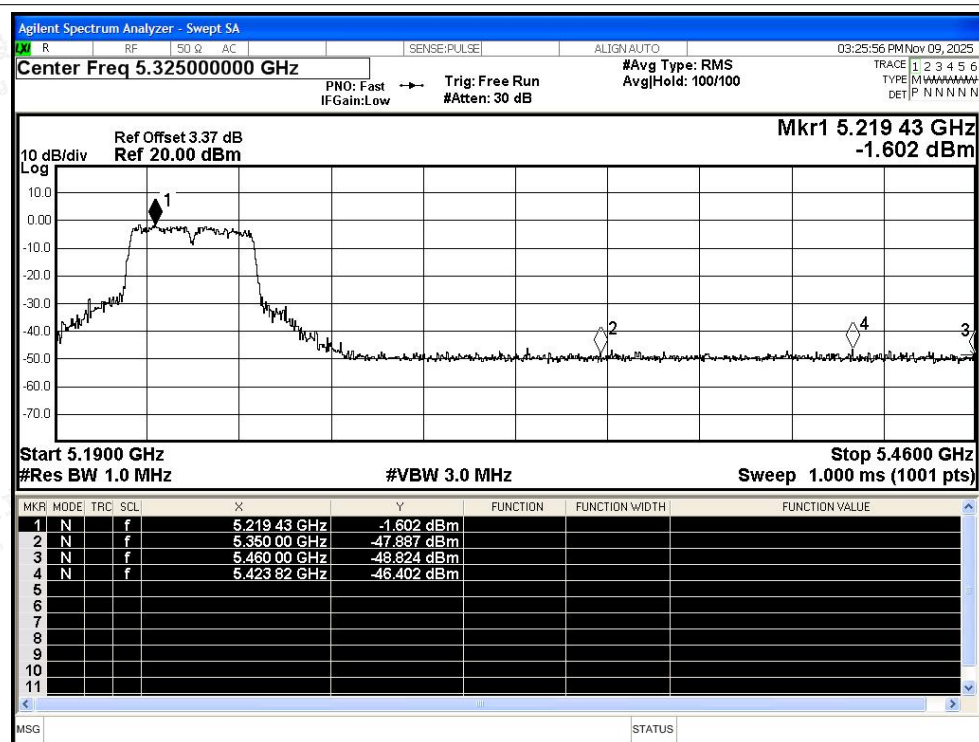

Restrict Band NVNT ax40 5230MHz Ant1 Average

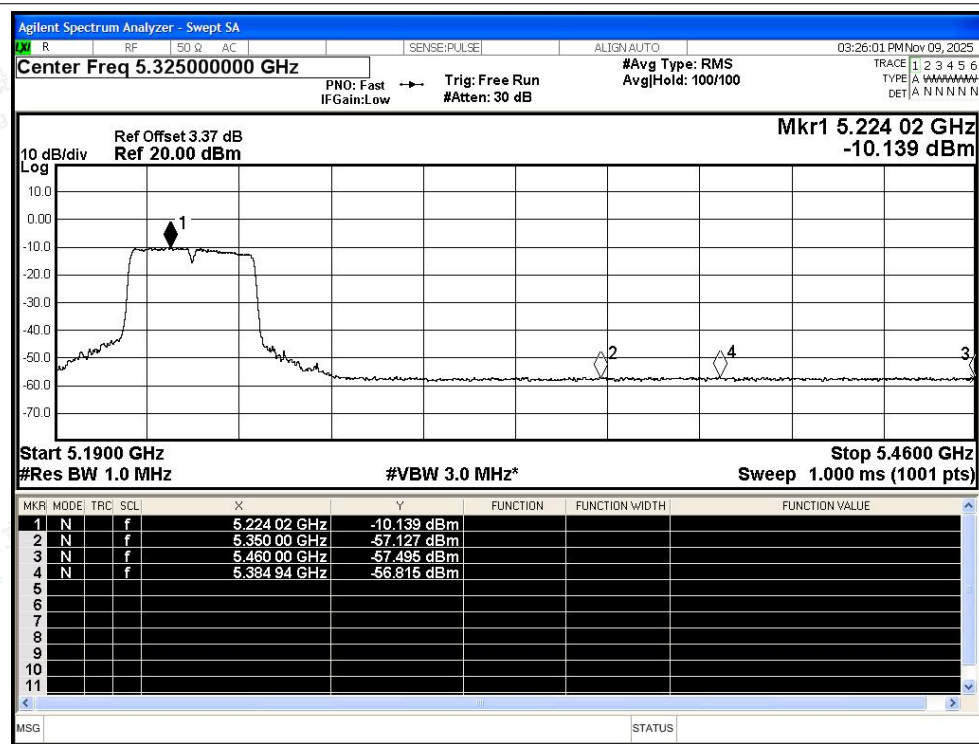

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5210MHz Ant1 Peak

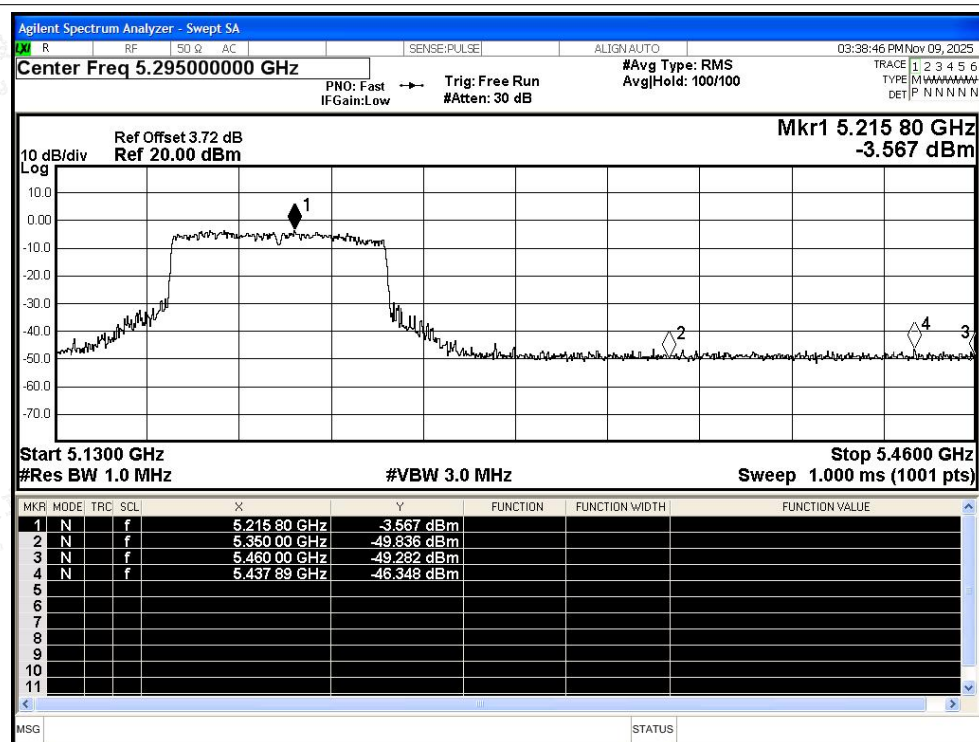

Restrict Band NVNT ax80 5210MHz Ant1 Average

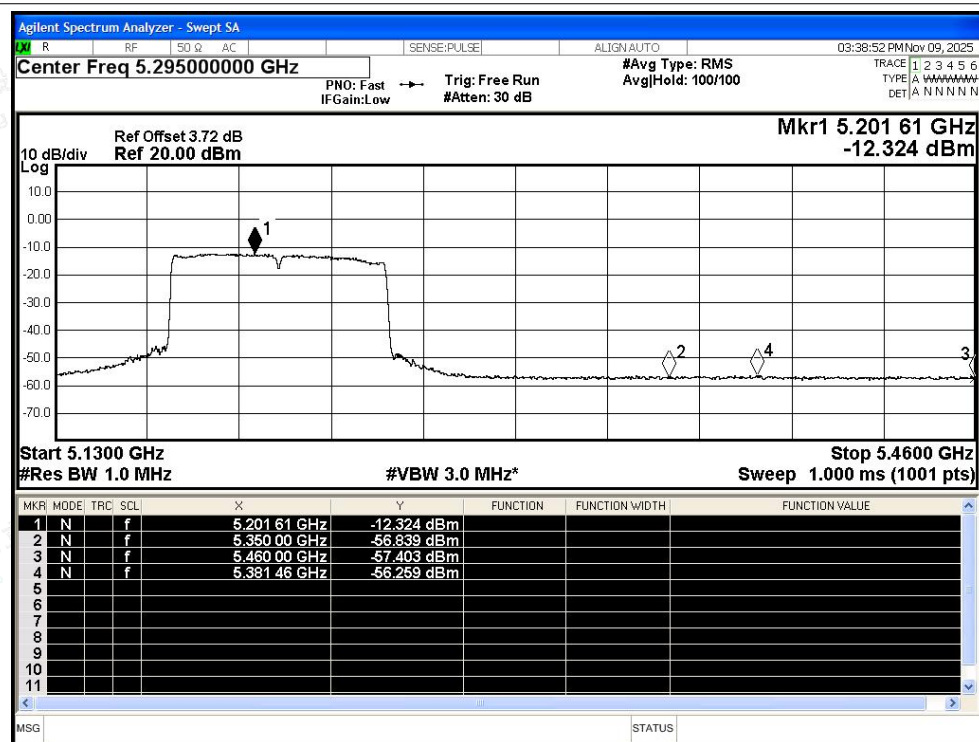

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5210MHz Ant1 Peak

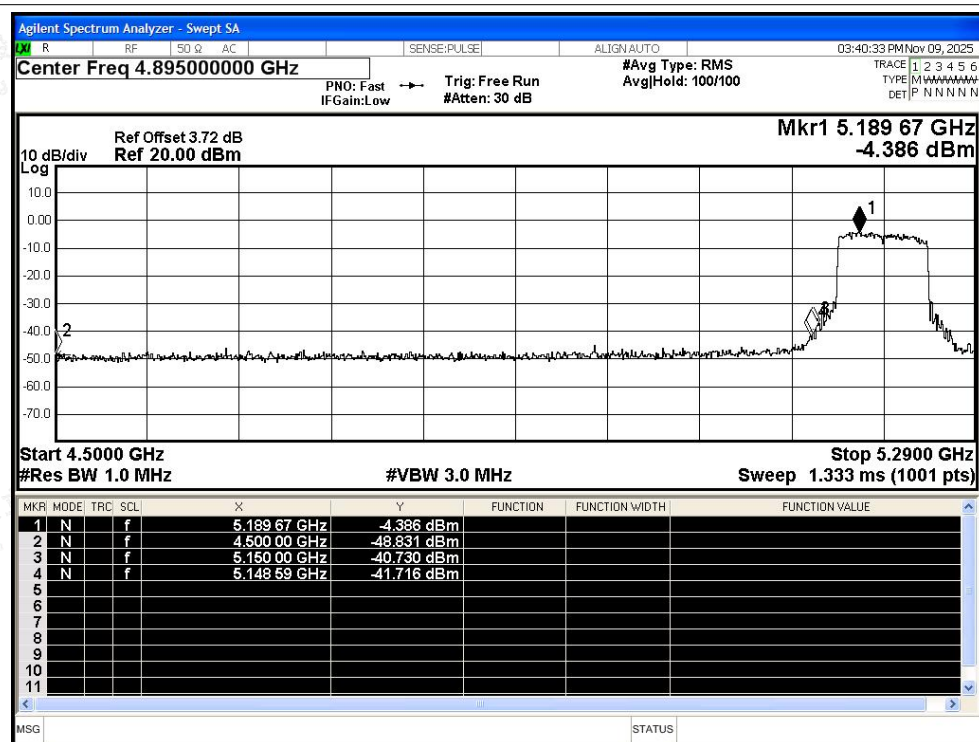

Restrict Band NVNT ax80 5210MHz Ant1 Average

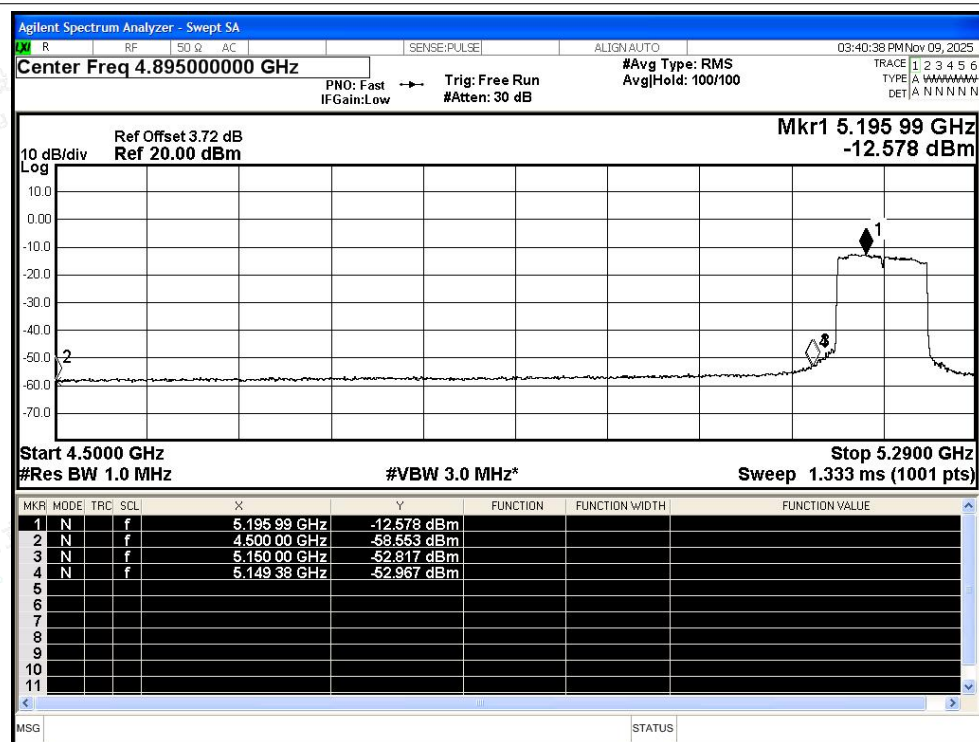

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5180	Ant2	4500	-50.15	5.58	-	50.66	Peak	68.2	Pass
NVNT	a	5180	Ant2	4500	-58	5.58	0.1	42.91	Average	54	Pass
NVNT	a	5180	Ant2	5148.2	-42.97	5.58	-	57.84	Peak	68.2	Pass
NVNT	a	5180	Ant2	5147.5	-54.99	5.58	0.1	45.92	Average	54	Pass
NVNT	a	5180	Ant2	5150	-44.58	5.58	-	56.23	Peak	68.2	Pass
NVNT	a	5180	Ant2	5150	-54.39	5.58	0.1	46.52	Average	54	Pass
NVNT	a	5240	Ant2	5350	-50	5.58	-	50.81	Peak	68.2	Pass
NVNT	a	5240	Ant2	5350	-57.41	5.58	0.1	43.50	Average	54	Pass
NVNT	a	5240	Ant2	5396.4	-46.57	5.58	-	54.24	Peak	68.2	Pass
NVNT	a	5240	Ant2	5374.56	-56.61	5.58	0.1	44.30	Average	54	Pass
NVNT	a	5240	Ant2	5460	-49.43	5.58	-	51.38	Peak	68.2	Pass
NVNT	a	5240	Ant2	5460	-57.97	5.58	0.1	42.94	Average	54	Pass
NVNT	n20	5180	Ant2	4500	-49.33	5.58	-	51.48	Peak	68.2	Pass
NVNT	n20	5180	Ant2	4500	-58.08	5.58	0.12	42.85	Average	54	Pass
NVNT	n20	5180	Ant2	5149.6	-41.77	5.58	-	59.04	Peak	68.2	Pass
NVNT	n20	5180	Ant2	5149.6	-54.81	5.58	0.12	46.12	Average	54	Pass
NVNT	n20	5180	Ant2	5150	-42.51	5.58	-	58.30	Peak	68.2	Pass
NVNT	n20	5180	Ant2	5150	-55.2	5.58	0.12	45.73	Average	54	Pass
NVNT	n20	5240	Ant2	5350	-49.21	5.58	-	51.60	Peak	68.2	Pass
NVNT	n20	5240	Ant2	5350	-57.37	5.58	0.12	43.56	Average	54	Pass
NVNT	n20	5240	Ant2	5436	-46.56	5.58	-	54.25	Peak	68.2	Pass
NVNT	n20	5240	Ant2	5396.64	-56.99	5.58	0.12	43.94	Average	54	Pass
NVNT	n20	5240	Ant2	5460	-49.63	5.58	-	51.18	Peak	68.2	Pass
NVNT	n20	5240	Ant2	5460	-57.67	5.58	0.12	43.26	Average	54	Pass
NVNT	n40	5190	Ant2	4500	-50.57	5.58	-	50.24	Peak	68.2	Pass
NVNT	n40	5190	Ant2	4500	-58.38	5.58	0.23	42.66	Average	54	Pass
NVNT	n40	5190	Ant2	5148.97	-40.59	5.58	-	60.22	Peak	68.2	Pass
NVNT	n40	5190	Ant2	5149.7	-53.17	5.58	0.23	47.87	Average	54	Pass
NVNT	n40	5190	Ant2	5150	-40.92	5.58	-	59.89	Peak	68.2	Pass
NVNT	n40	5190	Ant2	5150	-53.17	5.58	0.23	47.87	Average	54	Pass
NVNT	n40	5230	Ant2	5350	-49.02	5.58	-	51.79	Peak	68.2	Pass
NVNT	n40	5230	Ant2	5350	-58.24	5.58	0.23	42.80	Average	54	Pass
NVNT	n40	5230	Ant2	5381.43	-45.98	5.58	-	54.83	Peak	68.2	Pass
NVNT	n40	5230	Ant2	5391.69	-56.73	5.58	0.23	44.31	Average	54	Pass
NVNT	n40	5230	Ant2	5460	-48.97	5.58	-	51.84	Peak	68.2	Pass
NVNT	n40	5230	Ant2	5460	-57.78	5.58	0.23	43.26	Average	54	Pass
NVNT	ac20	5180	Ant2	4500	-48.73	5.58	-	52.08	Peak	68.2	Pass
NVNT	ac20	5180	Ant2	4500	-58.13	5.58	0.12	42.80	Average	54	Pass
NVNT	ac20	5180	Ant2	5145.4	-42.95	5.58	-	57.86	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5180	Ant2	5148.9	-54.5	5.58	0.12	46.43	Average	54	Pass
NVNT	ac20	5180	Ant2	5150	-42.59	5.58	-	58.22	Peak	68.2	Pass
NVNT	ac20	5180	Ant2	5150	-52.91	5.58	0.12	48.02	Average	54	Pass
NVNT	ac20	5240	Ant2	5350	-49.99	5.58	-	50.82	Peak	68.2	Pass
NVNT	ac20	5240	Ant2	5350	-57.67	5.58	0.12	43.26	Average	54	Pass
NVNT	ac20	5240	Ant2	5382.24	-46.79	5.58	-	54.02	Peak	68.2	Pass
NVNT	ac20	5240	Ant2	5392.08	-56.79	5.58	0.12	44.14	Average	54	Pass
NVNT	ac20	5240	Ant2	5460	-49.19	5.58	-	51.62	Peak	68.2	Pass
NVNT	ac20	5240	Ant2	5460	-58.15	5.58	0.12	42.78	Average	54	Pass
NVNT	ac40	5190	Ant2	4500	-48.99	5.58	-	51.82	Peak	68.2	Pass
NVNT	ac40	5190	Ant2	4500	-57.95	5.58	0.24	43.10	Average	54	Pass
NVNT	ac40	5190	Ant2	5147.51	-38.74	5.58	-	62.07	Peak	68.2	Pass
NVNT	ac40	5190	Ant2	5149.7	-52.9	5.58	0.24	48.15	Average	54	Pass
NVNT	ac40	5190	Ant2	5150	-43.63	5.58	-	57.18	Peak	68.2	Pass
NVNT	ac40	5190	Ant2	5150	-52.9	5.58	0.24	48.15	Average	54	Pass
NVNT	ac40	5230	Ant2	5350	-49.12	5.58	-	51.69	Peak	68.2	Pass
NVNT	ac40	5230	Ant2	5350	-57.41	5.58	0.23	43.63	Average	54	Pass
NVNT	ac40	5230	Ant2	5372.52	-46.51	5.58	-	54.30	Peak	68.2	Pass
NVNT	ac40	5230	Ant2	5356.05	-56.88	5.58	0.23	44.16	Average	54	Pass
NVNT	ac40	5230	Ant2	5460	-49.6	5.58	-	51.21	Peak	68.2	Pass
NVNT	ac40	5230	Ant2	5460	-57.69	5.58	0.23	43.35	Average	54	Pass
NVNT	ac80	5210	Ant2	5350	-48.53	5.58	-	52.28	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5350	-57.28	5.58	0.47	44.00	Average	54	Pass
NVNT	ac80	5210	Ant2	5361	-46.1	5.58	-	54.71	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5365.62	-56.49	5.58	0.47	44.79	Average	54	Pass
NVNT	ac80	5210	Ant2	5460	-49.9	5.58	-	50.91	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5460	-57.4	5.58	0.47	43.88	Average	54	Pass
NVNT	ac80	5210	Ant2	4500	-49.43	5.58	-	51.38	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	4500	-58.14	5.58	0.47	43.14	Average	54	Pass
NVNT	ac80	5210	Ant2	5149.38	-41.96	5.58	-	58.85	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5148.59	-52.81	5.58	0.47	48.47	Average	54	Pass
NVNT	ac80	5210	Ant2	5150	-41.95	5.58	-	58.86	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5150	-53	5.58	0.47	48.28	Average	54	Pass
NVNT	ax20	5180	Ant2	4500	-50.33	5.58	-	50.48	Peak	68.2	Pass
NVNT	ax20	5180	Ant2	4500	-57.91	5.58	0.12	43.02	Average	54	Pass
NVNT	ax20	5180	Ant2	5149.6	-43.29	5.58	-	57.52	Peak	68.2	Pass
NVNT	ax20	5180	Ant2	5148.9	-54.41	5.58	0.12	46.52	Average	54	Pass
NVNT	ax20	5180	Ant2	5150	-41.23	5.58	-	59.58	Peak	68.2	Pass
NVNT	ax20	5180	Ant2	5150	-54.28	5.58	0.12	46.65	Average	54	Pass
NVNT	ax20	5240	Ant2	5350	-49.44	5.58	-	51.37	Peak	68.2	Pass
NVNT	ax20	5240	Ant2	5350	-57.63	5.58	0.12	43.30	Average	54	Pass
NVNT	ax20	5240	Ant2	5418.72	-46.5	5.58	-	54.31	Peak	68.2	Pass
NVNT	ax20	5240	Ant2	5416.08	-56.72	5.58	0.12	44.21	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax20	5240	Ant2	5460	-50.72	5.58	-	50.09	Peak	68.2	Pass
NVNT	ax20	5240	Ant2	5460	-57.89	5.58	0.12	43.04	Average	54	Pass
NVNT	ax40	5190	Ant2	4500	-49.09	5.58	-	51.72	Peak	68.2	Pass
NVNT	ax40	5190	Ant2	4500	-57.76	5.58	0.24	43.29	Average	54	Pass
NVNT	ax40	5190	Ant2	5148.24	-37.95	5.58	-	62.86	Peak	68.2	Pass
NVNT	ax40	5190	Ant2	5149.7	-52.82	5.58	0.24	48.23	Average	54	Pass
NVNT	ax40	5190	Ant2	5150	-44.93	5.58	-	55.88	Peak	68.2	Pass
NVNT	ax40	5190	Ant2	5150	-52.82	5.58	0.24	48.23	Average	54	Pass
NVNT	ax40	5230	Ant2	5350	-50.24	5.58	-	50.57	Peak	68.2	Pass
NVNT	ax40	5230	Ant2	5350	-57.86	5.58	0.24	43.19	Average	54	Pass
NVNT	ax40	5230	Ant2	5393.85	-46.82	5.58	-	53.99	Peak	68.2	Pass
NVNT	ax40	5230	Ant2	5356.05	-56.8	5.58	0.24	44.25	Average	54	Pass
NVNT	ax40	5230	Ant2	5460	-48.4	5.58	-	52.41	Peak	68.2	Pass
NVNT	ax40	5230	Ant2	5460	-58.44	5.58	0.24	42.61	Average	54	Pass
NVNT	ax80	5210	Ant2	5350	-47.31	5.58	-	53.50	Peak	68.2	Pass
NVNT	ax80	5210	Ant2	5350	-57.54	5.58	0.47	43.74	Average	54	Pass
NVNT	ax80	5210	Ant2	5458.02	-46.4	5.58	-	54.41	Peak	68.2	Pass
NVNT	ax80	5210	Ant2	5455.05	-56.36	5.58	0.47	44.92	Average	54	Pass
NVNT	ax80	5210	Ant2	5460	-48.76	5.58	-	52.05	Peak	68.2	Pass
NVNT	ax80	5210	Ant2	5460	-57.14	5.58	0.47	44.14	Average	54	Pass
NVNT	ax80	5210	Ant2	4500	-50.17	5.58	-	50.64	Peak	68.2	Pass
NVNT	ax80	5210	Ant2	4500	-57.92	5.58	0.47	43.36	Average	54	Pass
NVNT	ax80	5210	Ant2	5149.38	-41.06	5.58	-	59.75	Peak	68.2	Pass
NVNT	ax80	5210	Ant2	5149.38	-52.5	5.58	0.47	48.78	Average	54	Pass
NVNT	ax80	5210	Ant2	5150	-38.95	5.58	-	61.86	Peak	68.2	Pass
NVNT	ax80	5210	Ant2	5150	-52.55	5.58	0.47	48.73	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Restrict Band NVNT a 5180MHz Ant2 Peak

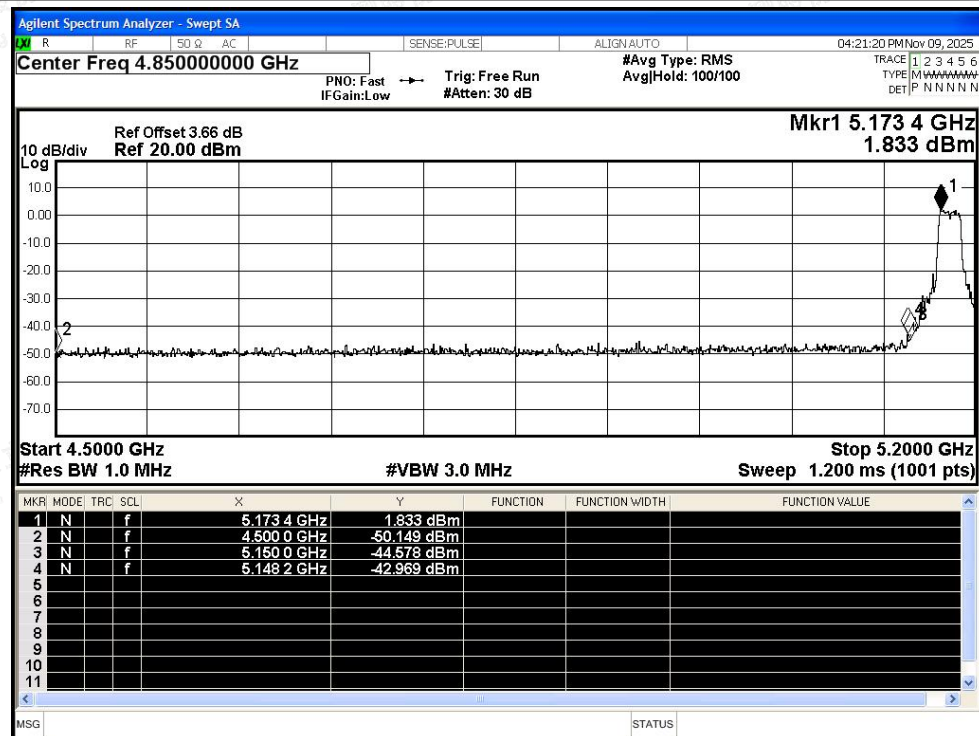

Restrict Band NVNT a 5180MHz Ant2 Average

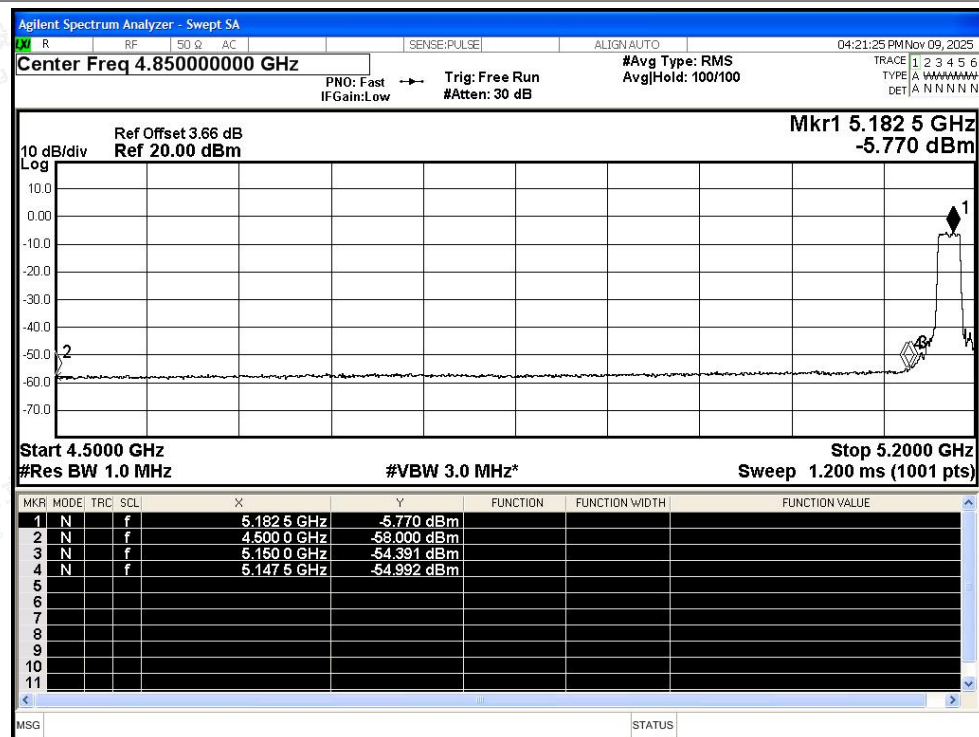

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5240MHz Ant2 Peak

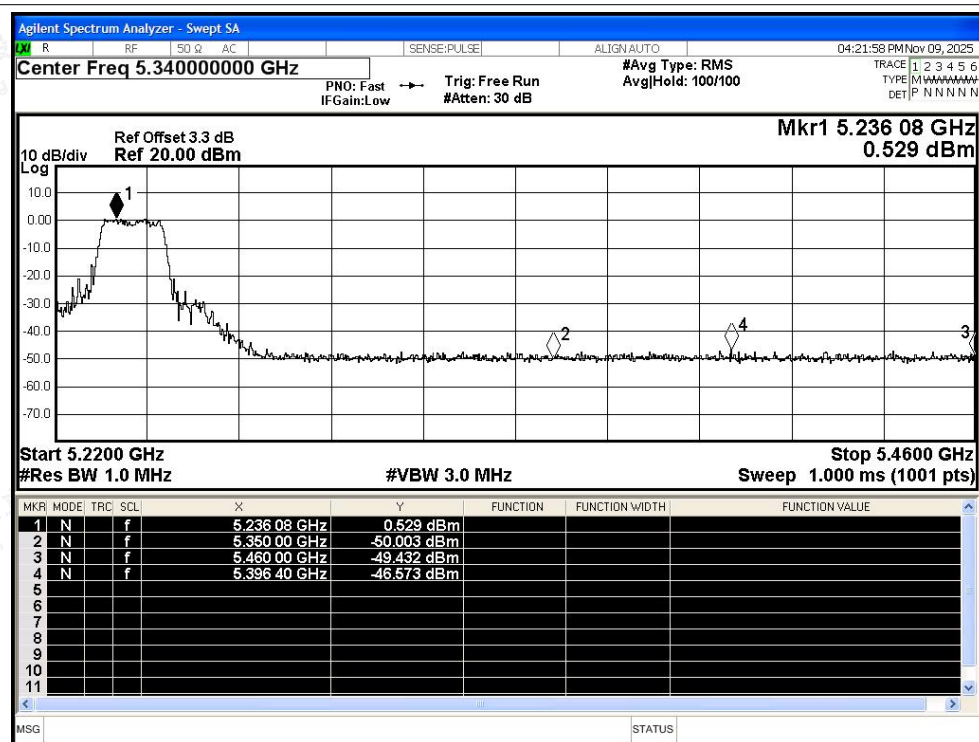

Restrict Band NVNT a 5240MHz Ant2 Average

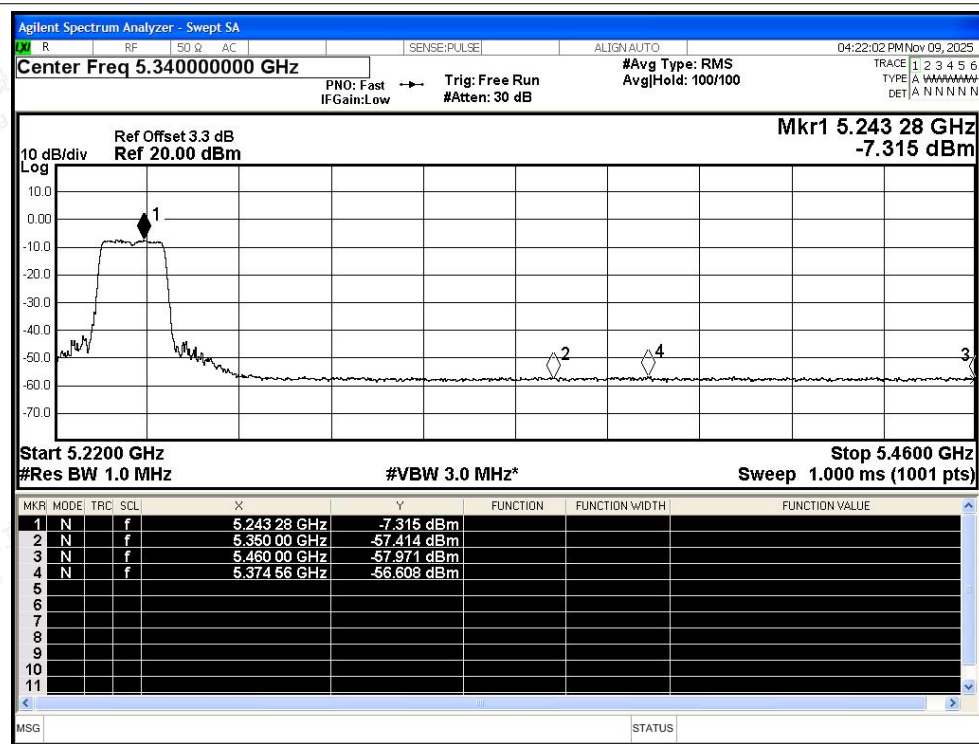

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5180MHz Ant2 Peak

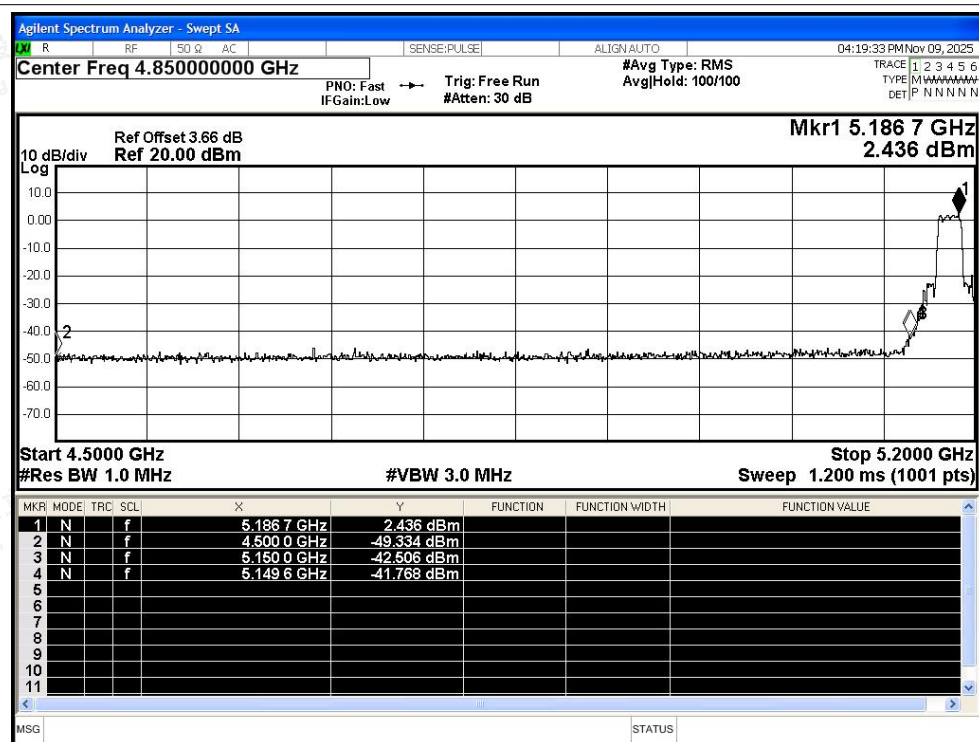

Restrict Band NVNT n20 5180MHz Ant2 Average

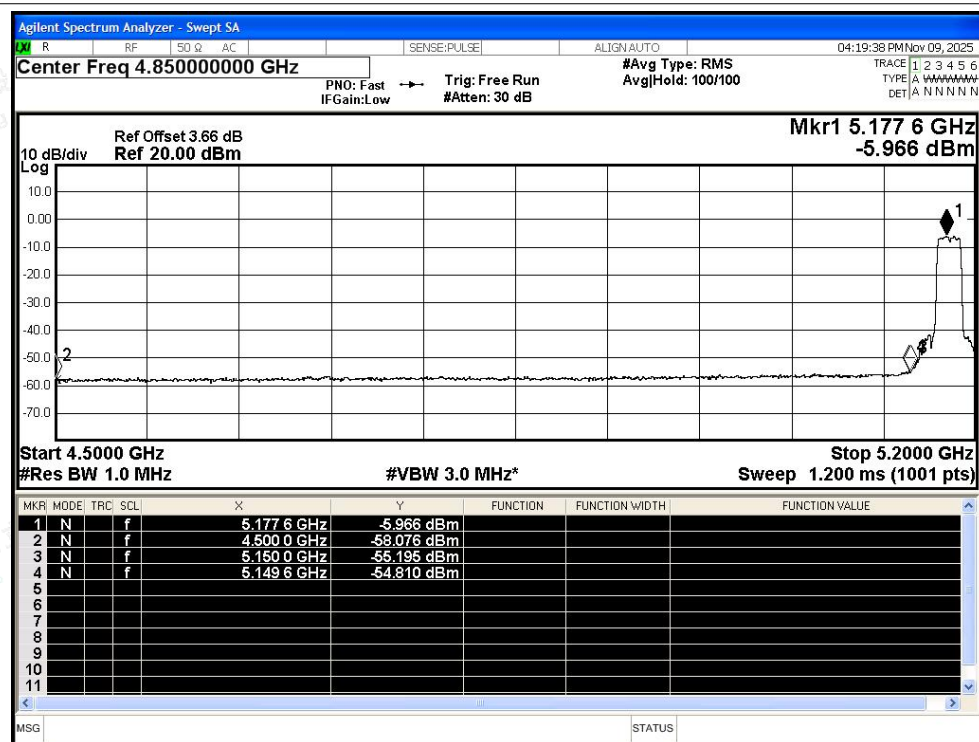

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5240MHz Ant2 Peak

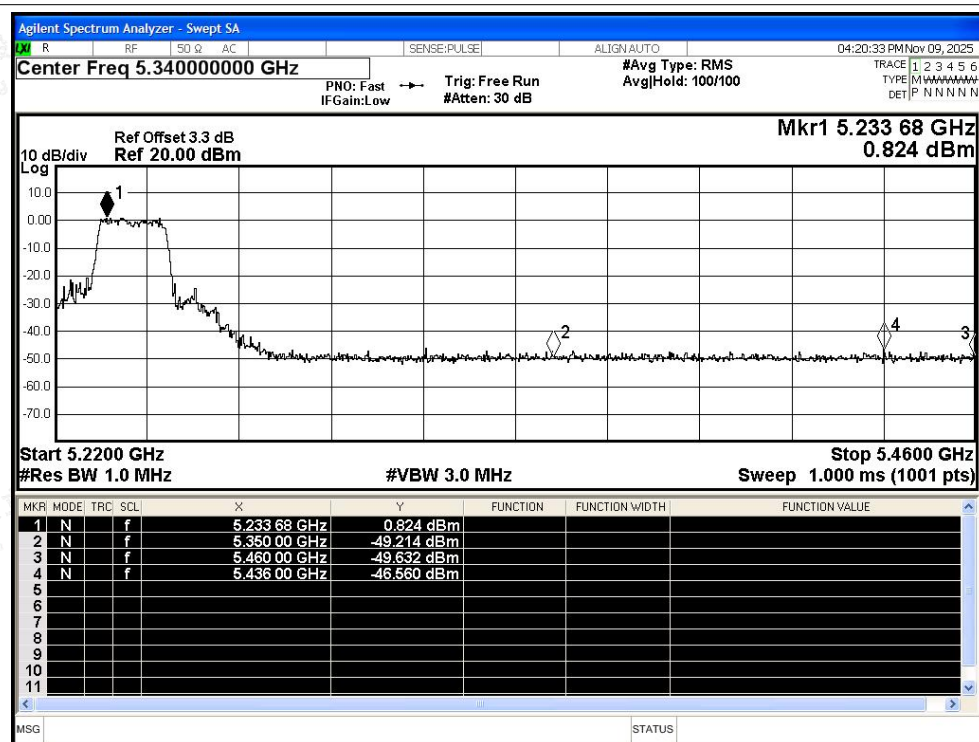

Restrict Band NVNT n20 5240MHz Ant2 Average

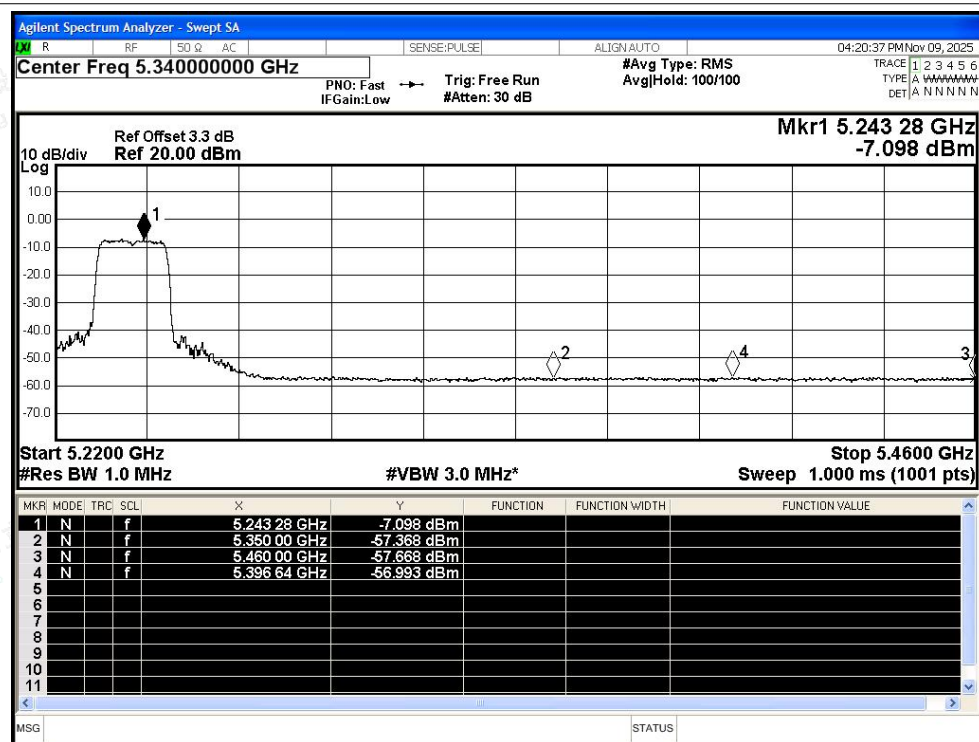

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity