
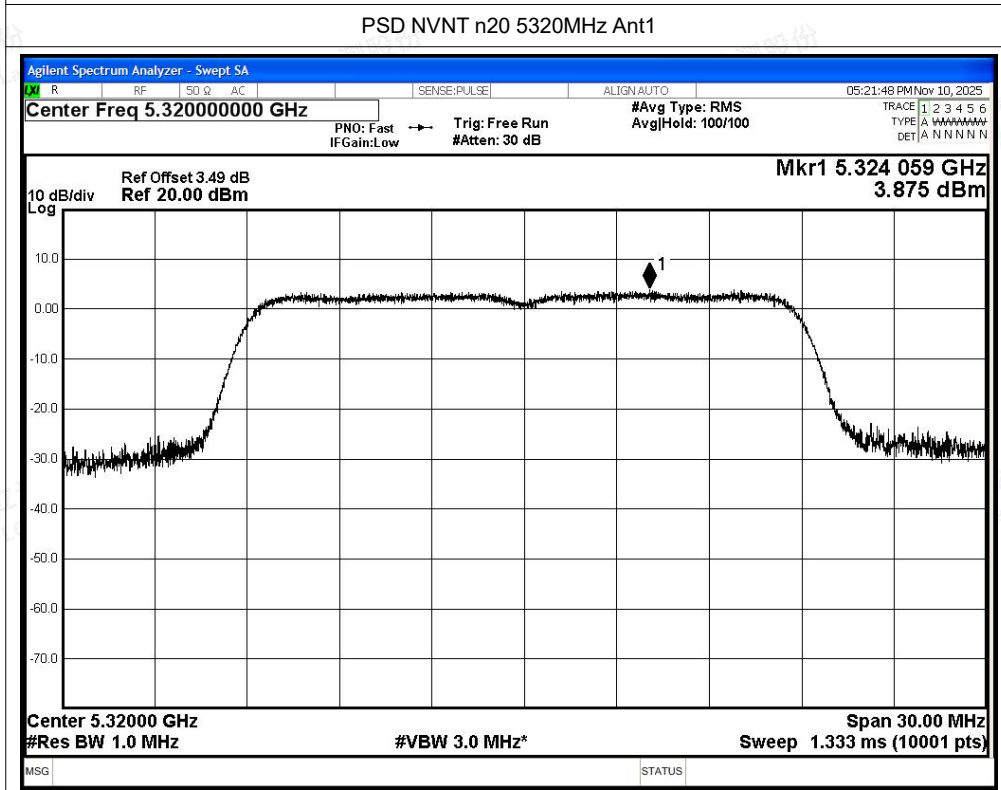



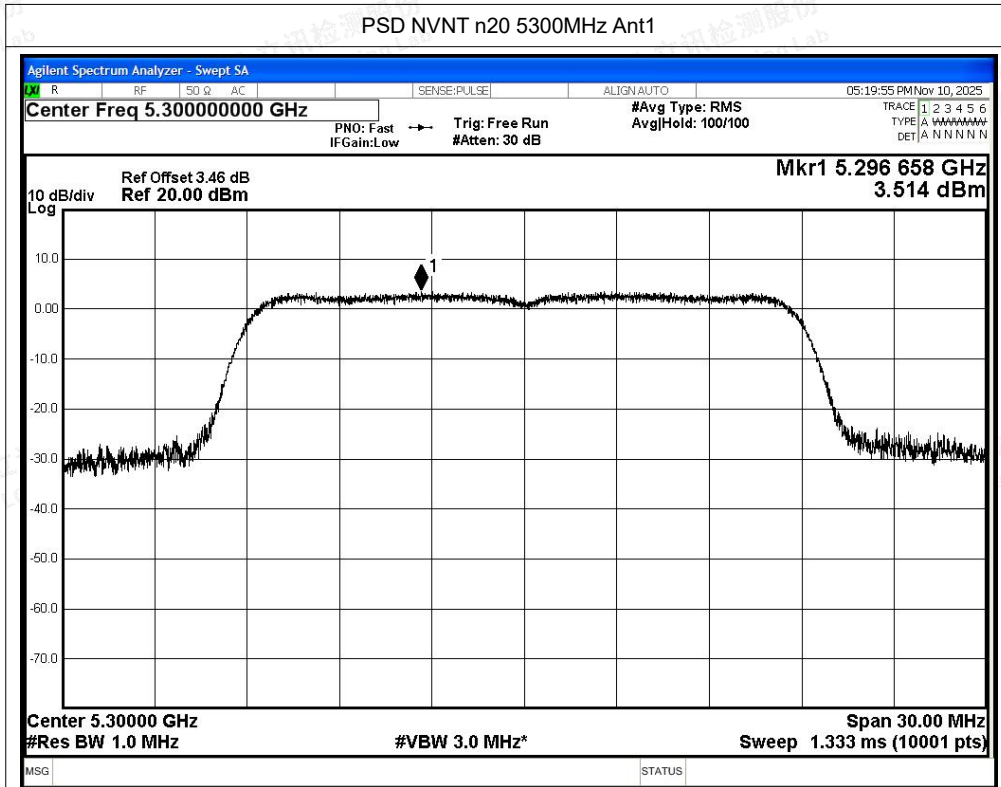


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

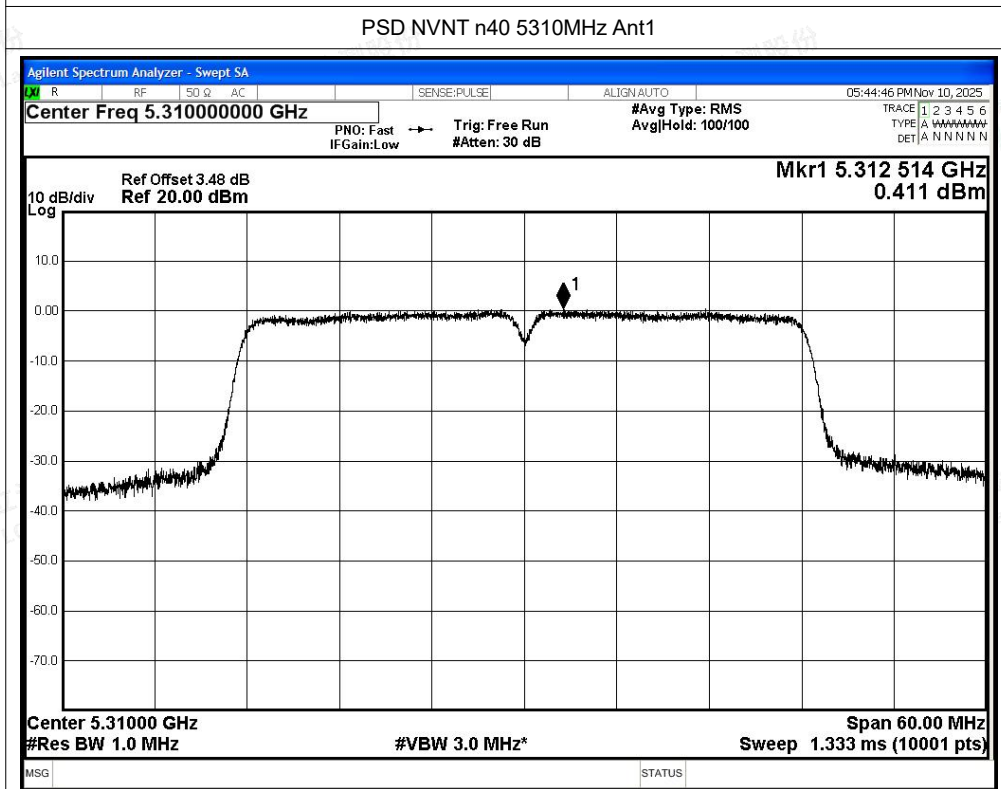
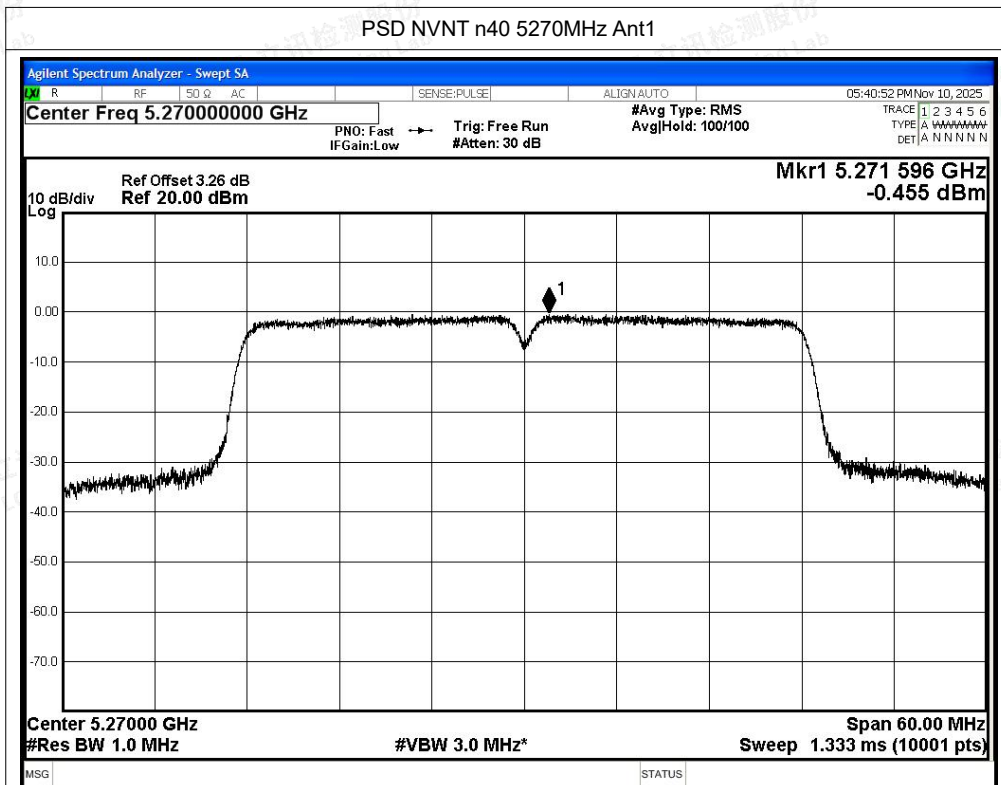


Shenzhen LCS Compliance Testing Laboratory Ltd.

Shenzhen ECS Compliance Testing Laboratory Ltd.  
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen,  
518000, China


Tel: +(86) 0755-82591330 | E-mail: [webmaster@lcs-cert.com](mailto:webmaster@lcs-cert.com) | Web: [www.lcs-cert.com](http://www.lcs-cert.com)

Scan code to check authenticity

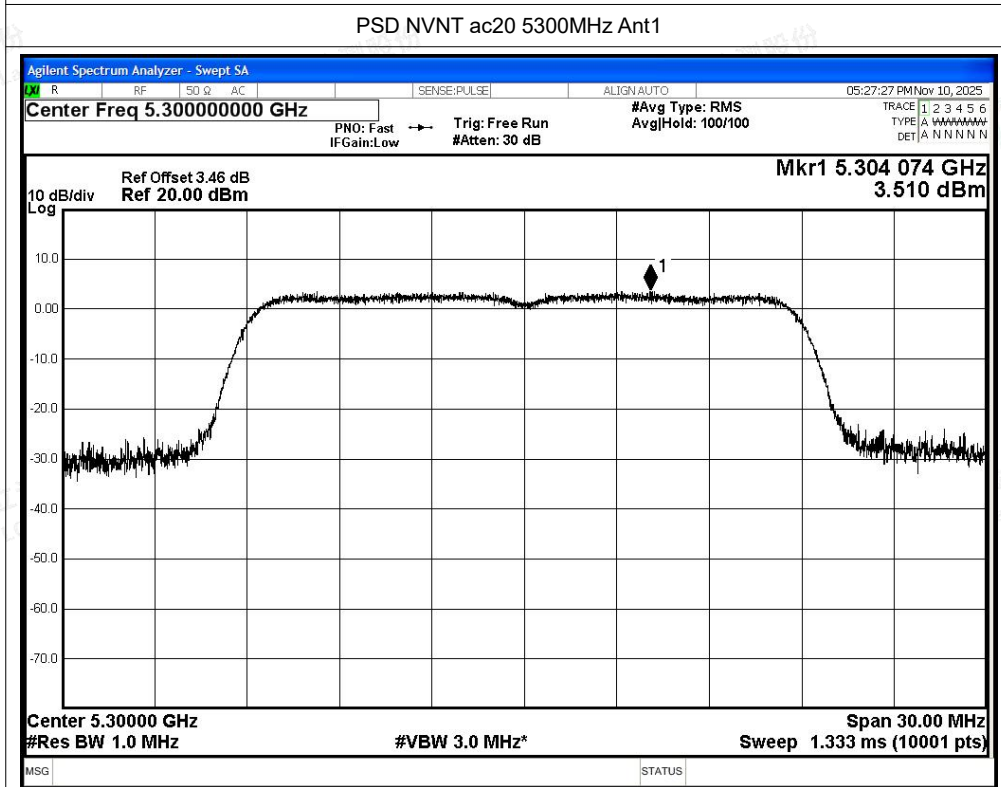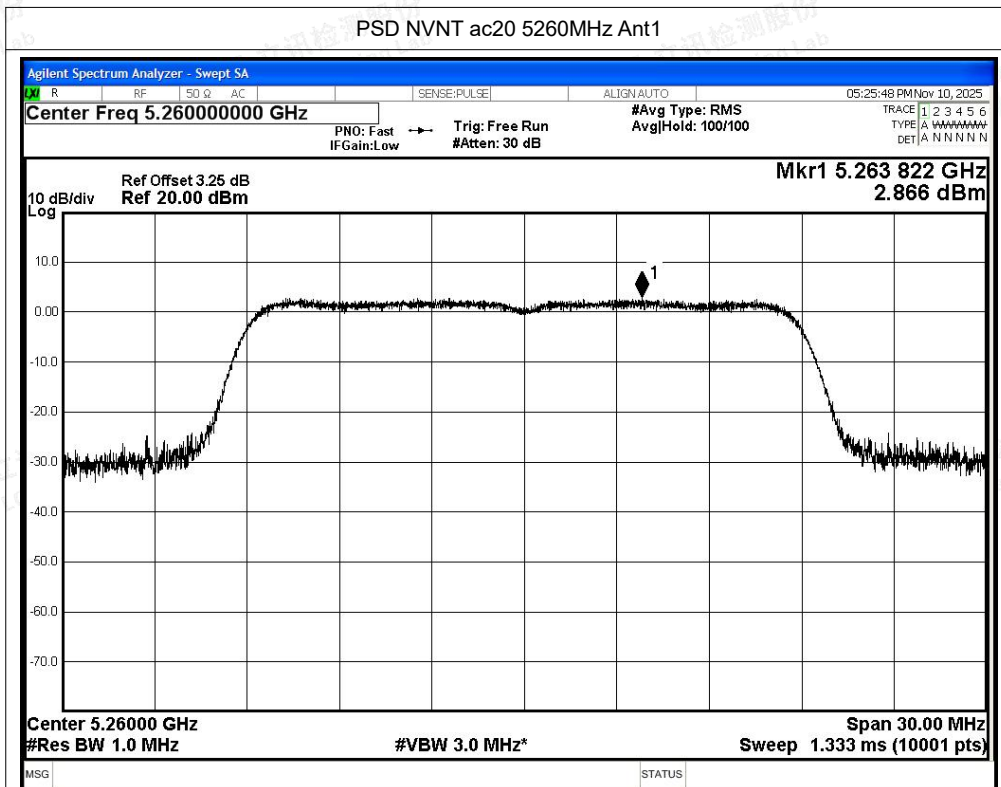




PSD NVNT ac20 5320MHz Ant1

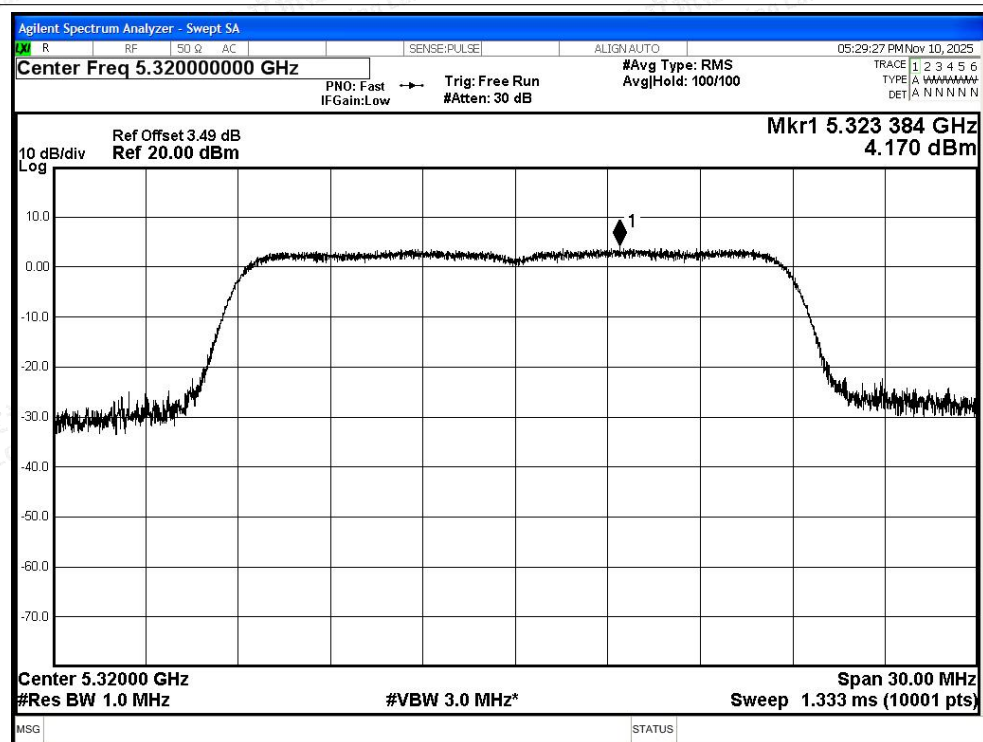

PSD NVNT ac40 5270MHz Ant1

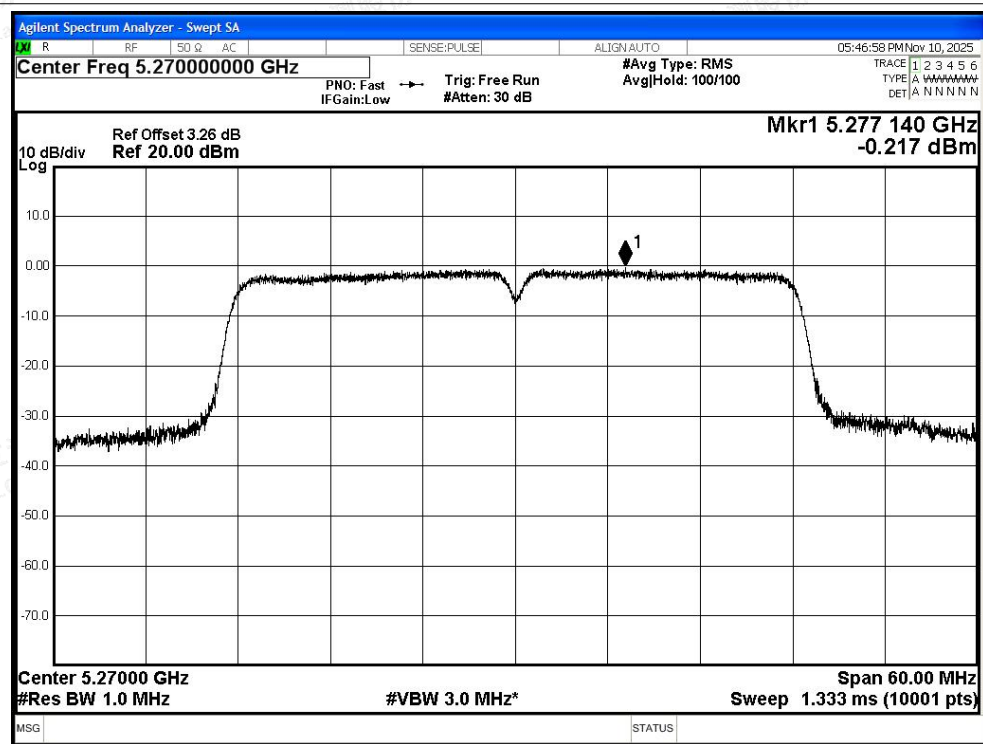

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ac40 5310MHz Ant1

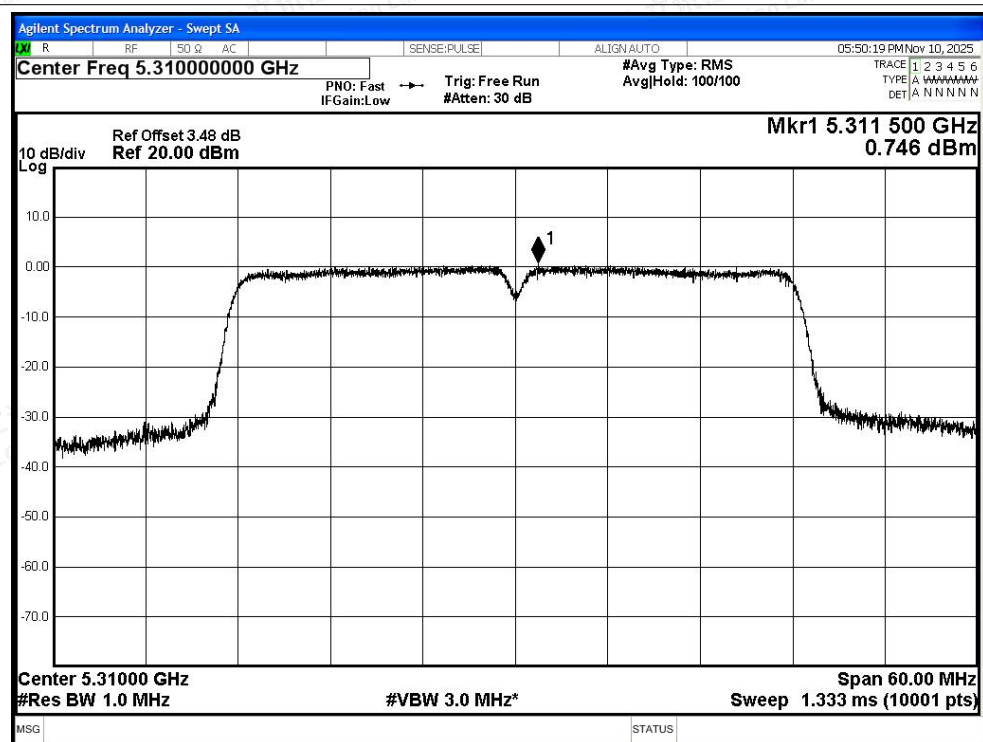

PSD NVNT ac80 5290MHz Ant1

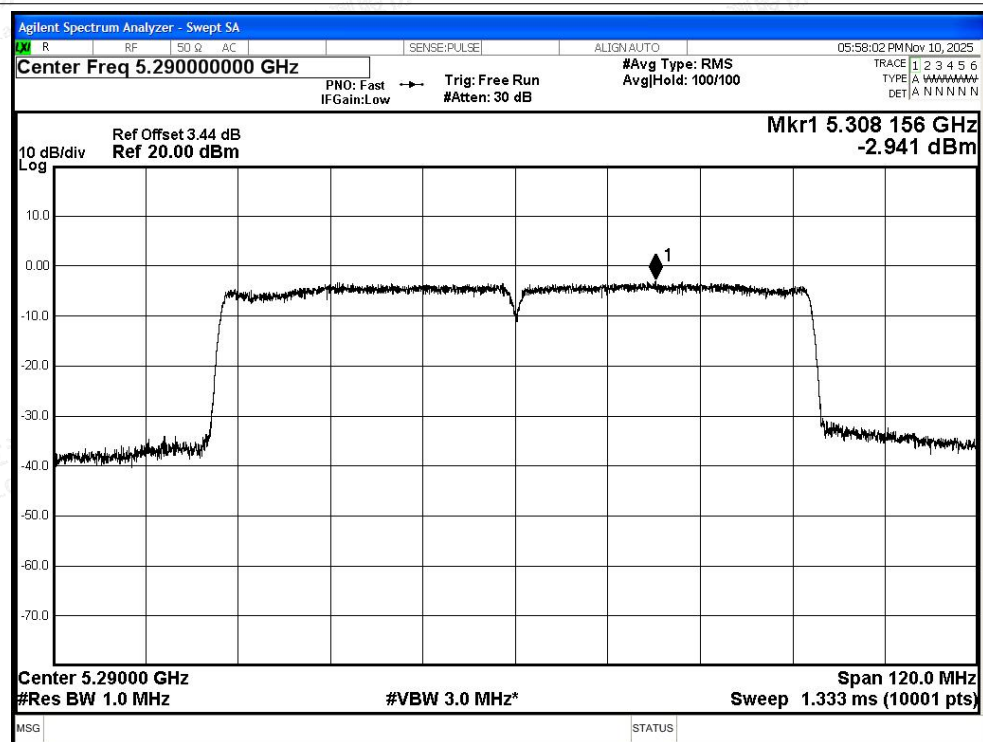

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ax20 5260MHz Ant1

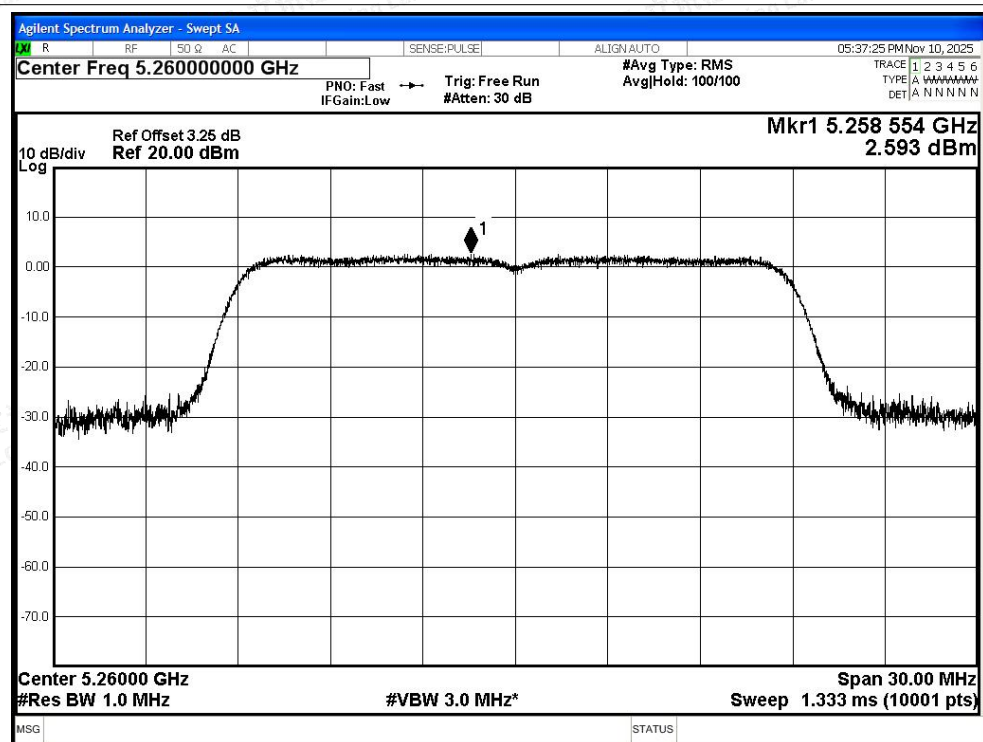

PSD NVNT ax20 5300MHz Ant1

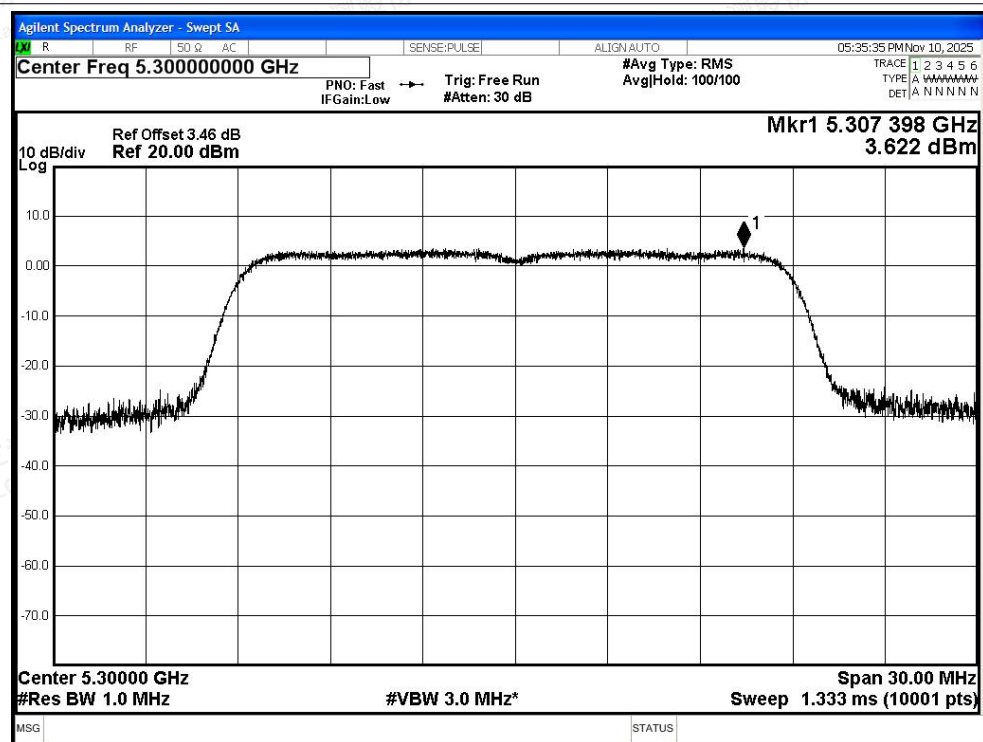

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ax20 5320MHz Ant1

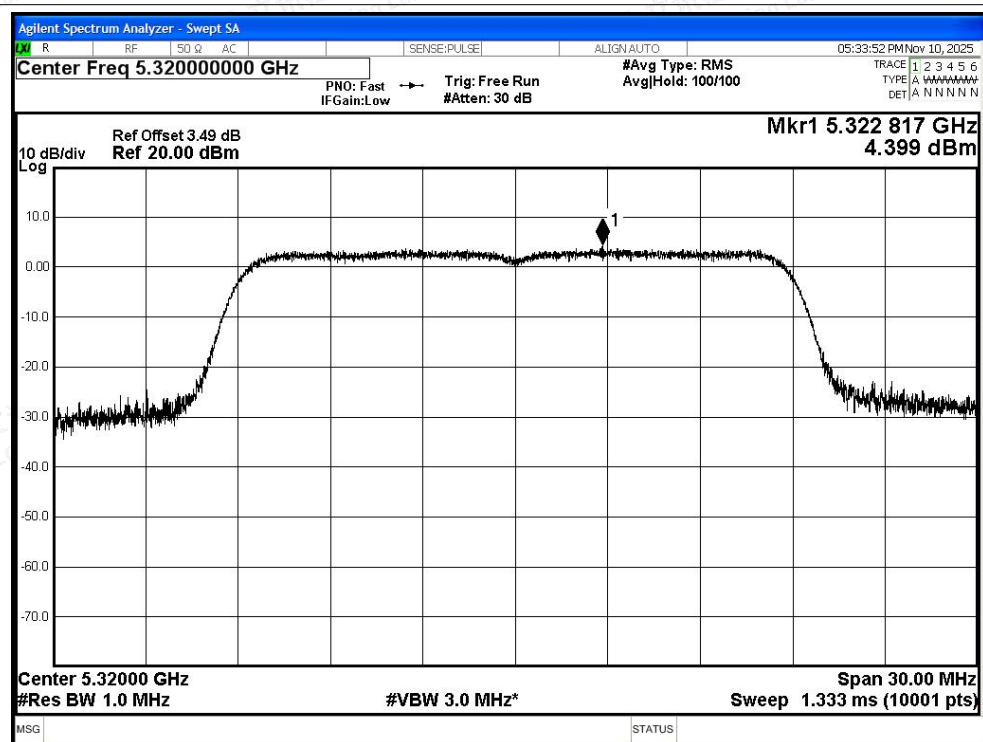

PSD NVNT ax40 5270MHz Ant1

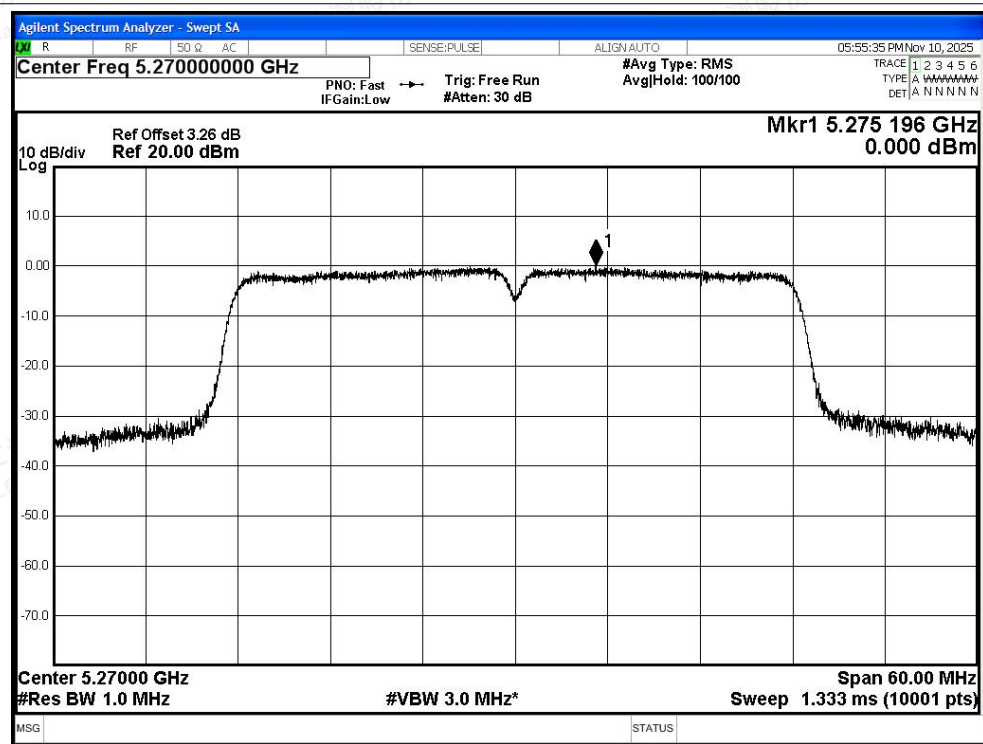

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ax40 5310MHz Ant1

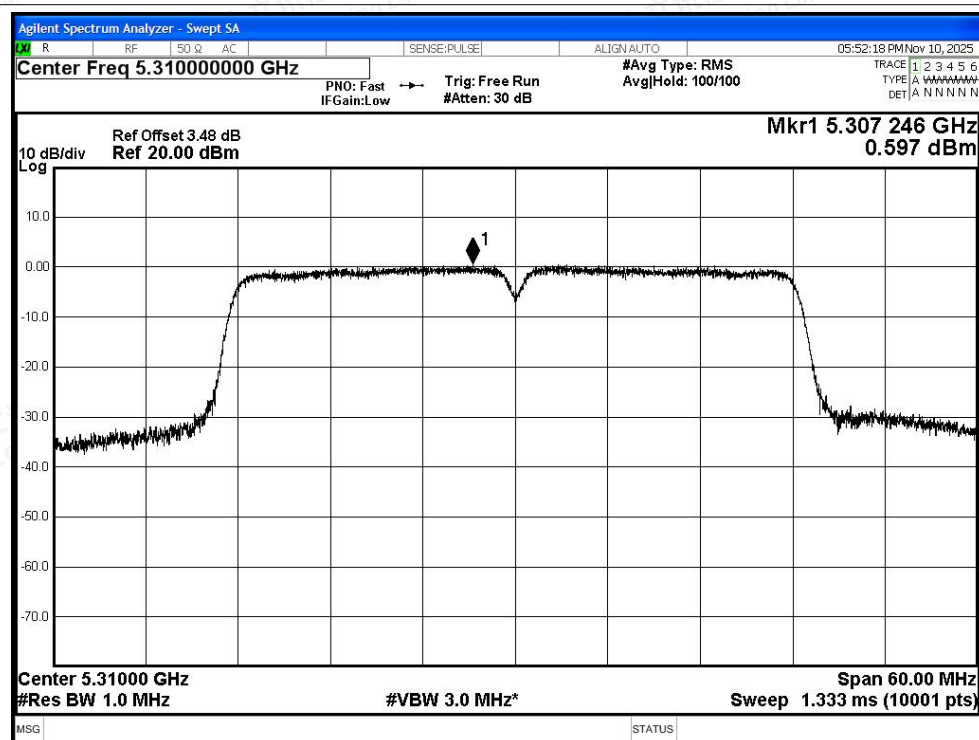

PSD NVNT ax80 5290MHz Ant1

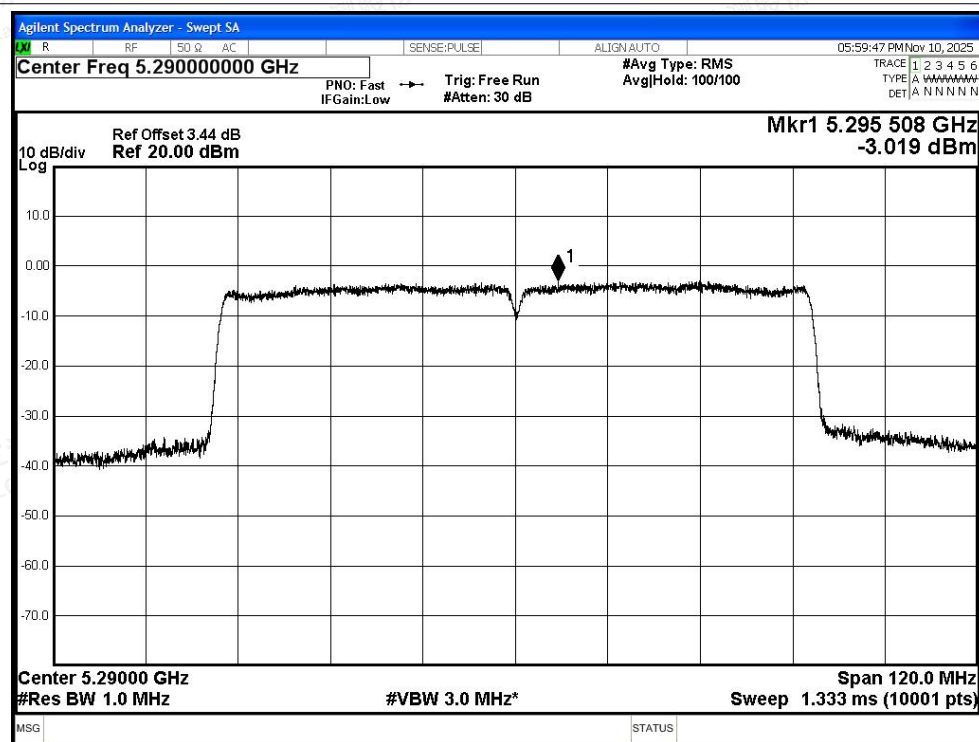

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




## Test Graphs

## PSD NVNT a 5260MHz Ant2

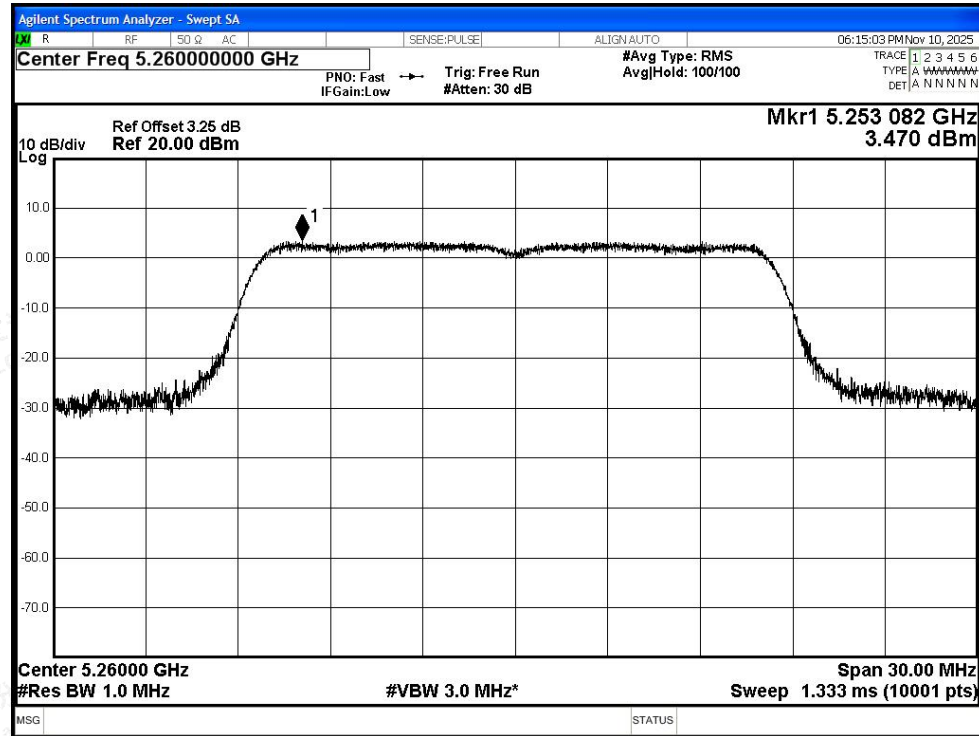

## PSD NVNT a 5300MHz Ant2

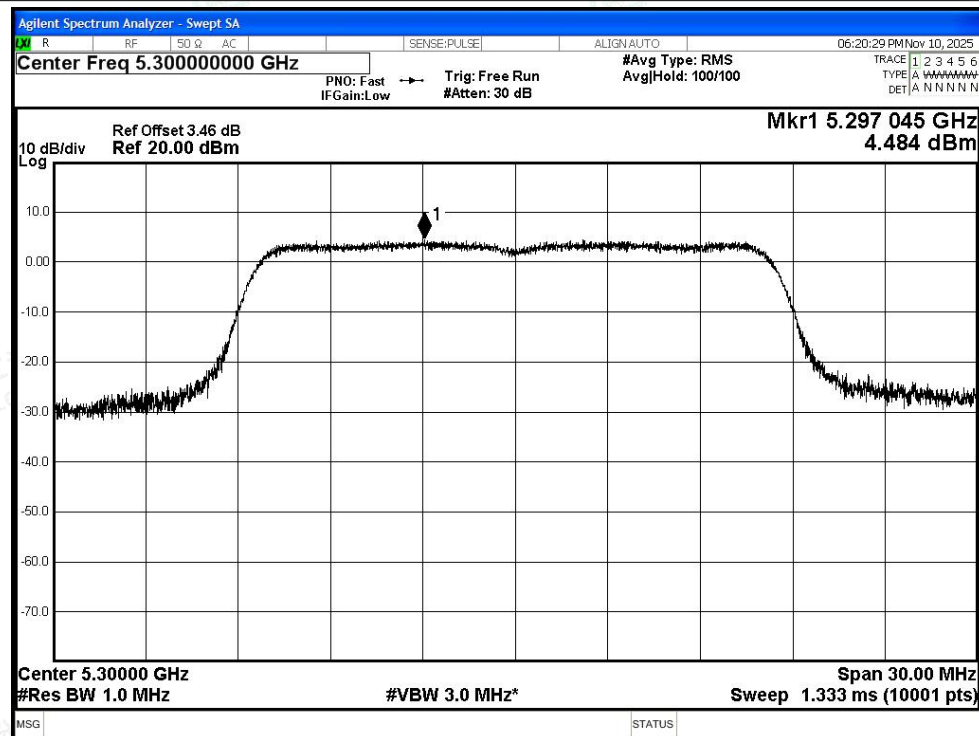

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT a 5320MHz Ant2

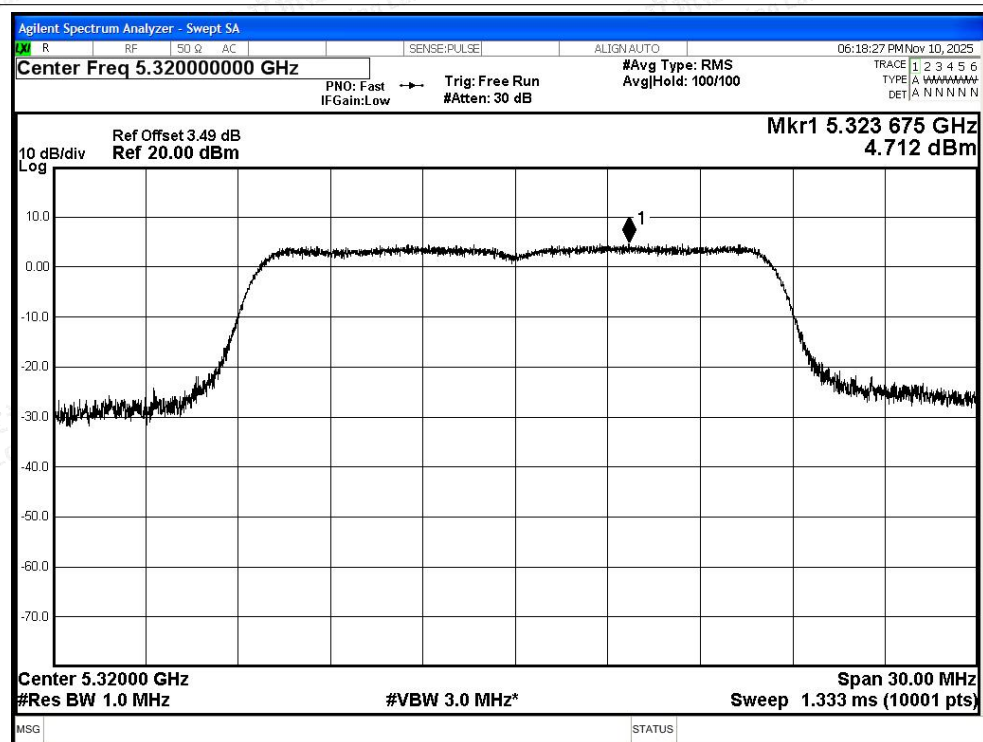

PSD NVNT n20 5260MHz Ant2


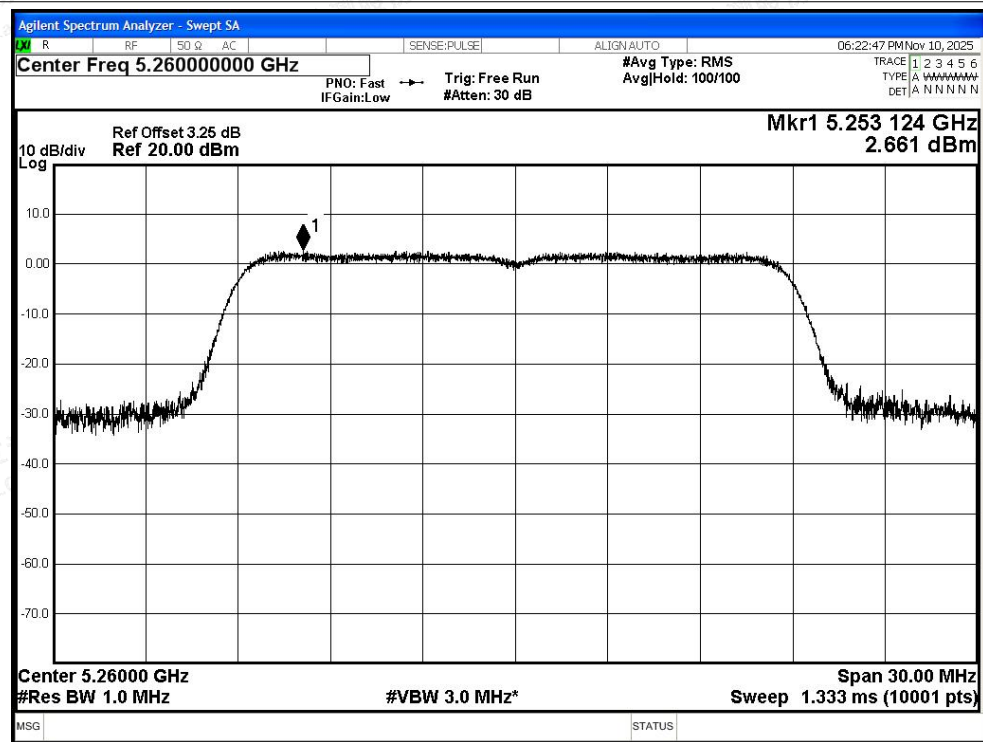


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

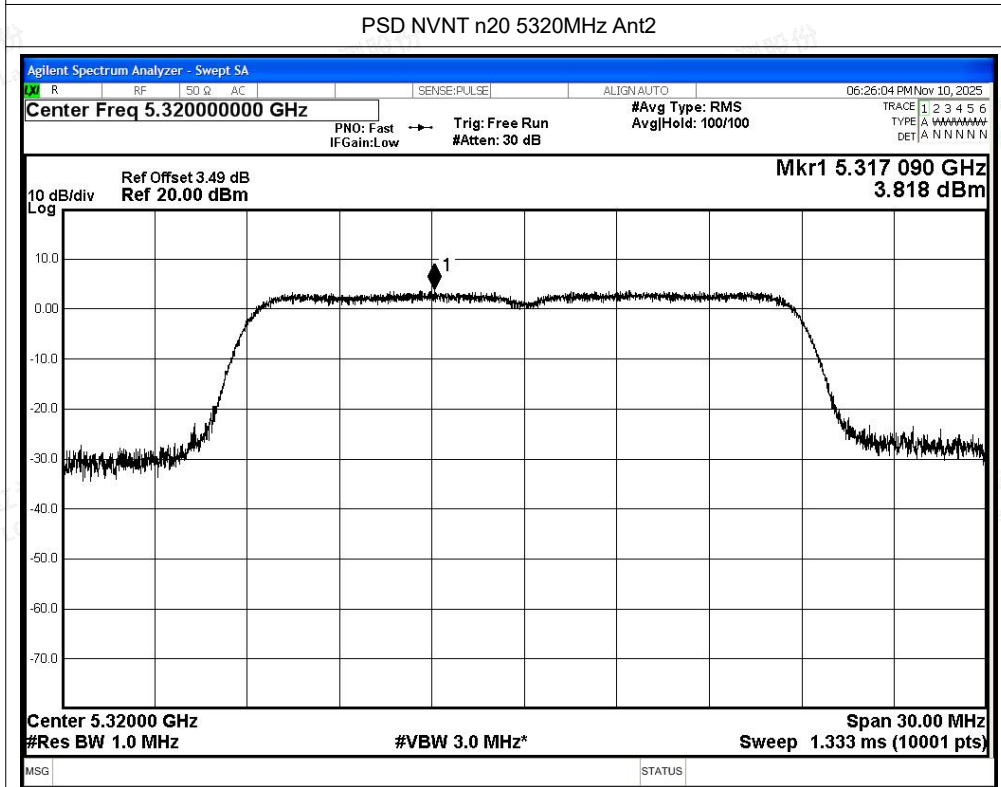
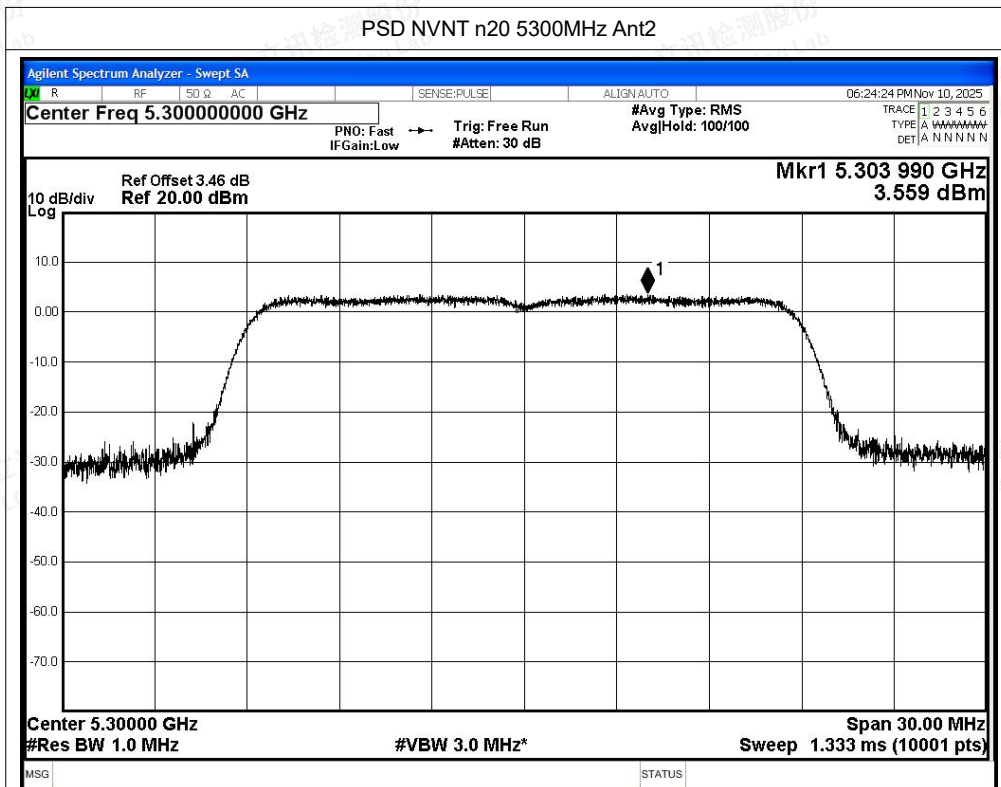


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

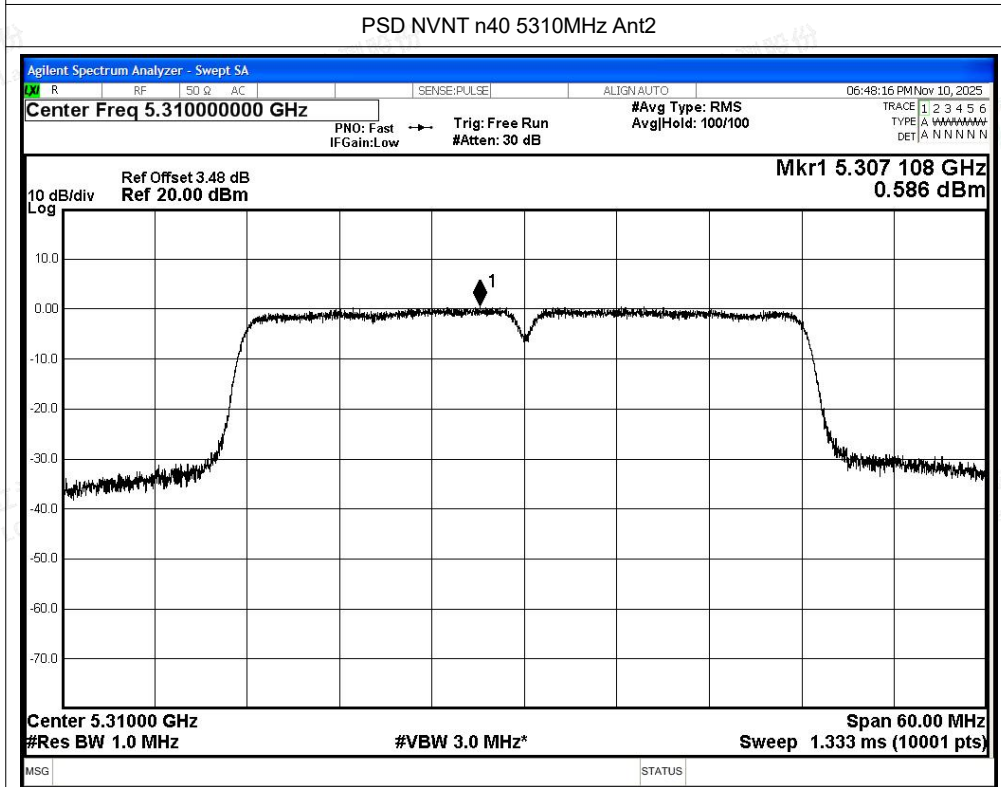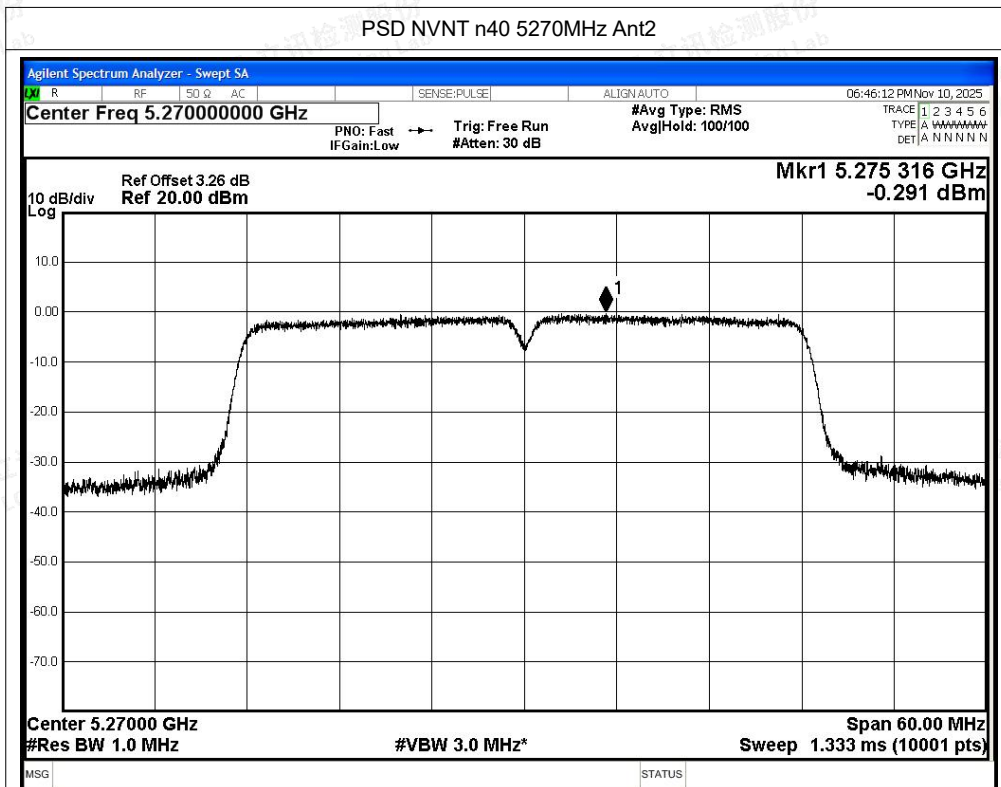

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ac20 5260MHz Ant2

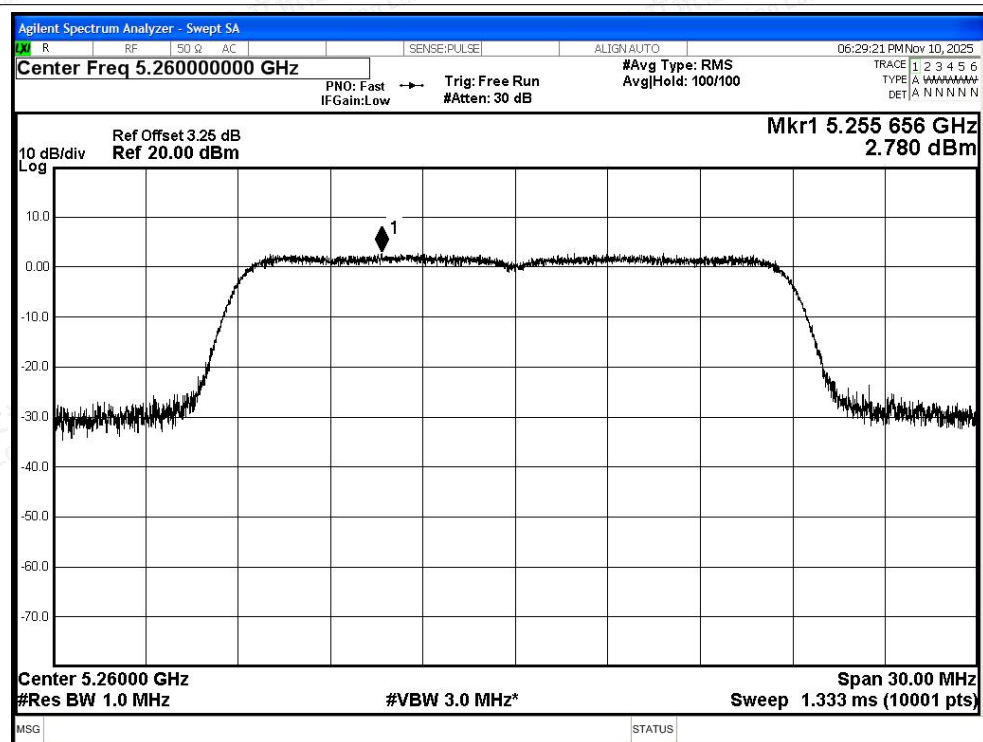

PSD NVNT ac20 5300MHz Ant2

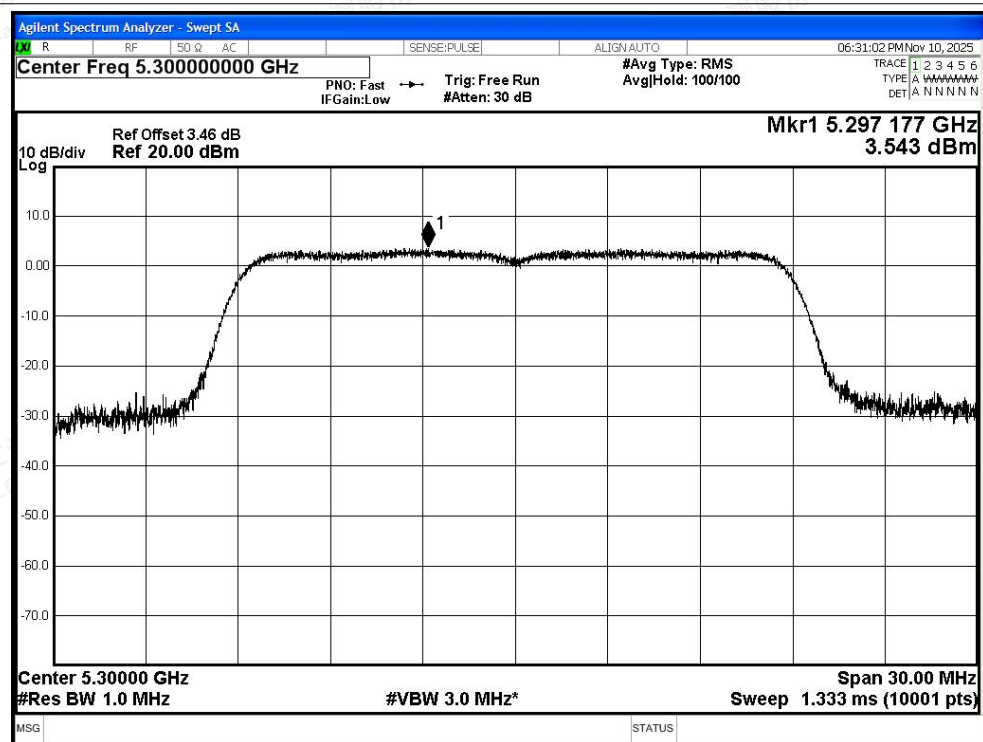

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ac20 5320MHz Ant2

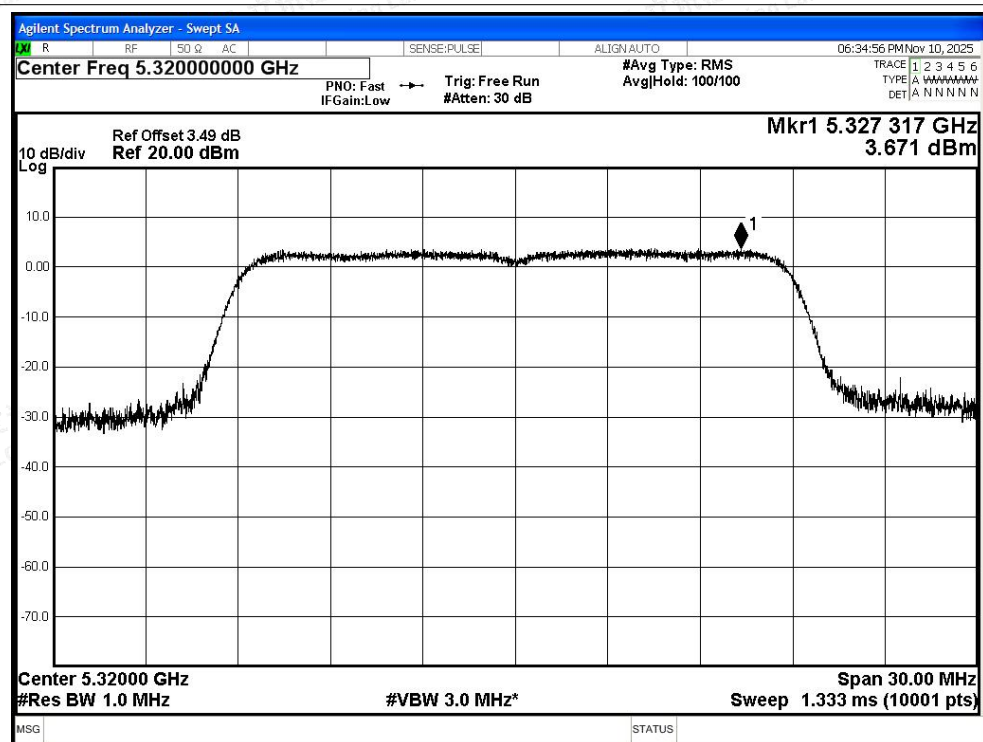

PSD NVNT ac40 5270MHz Ant2

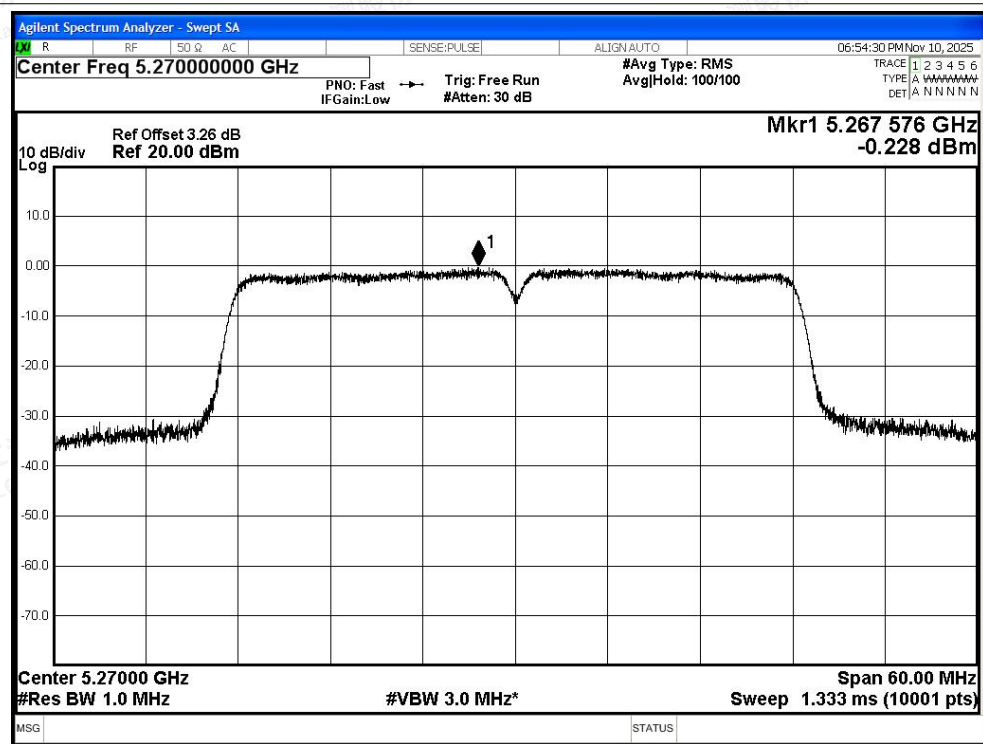

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ac40 5310MHz Ant2

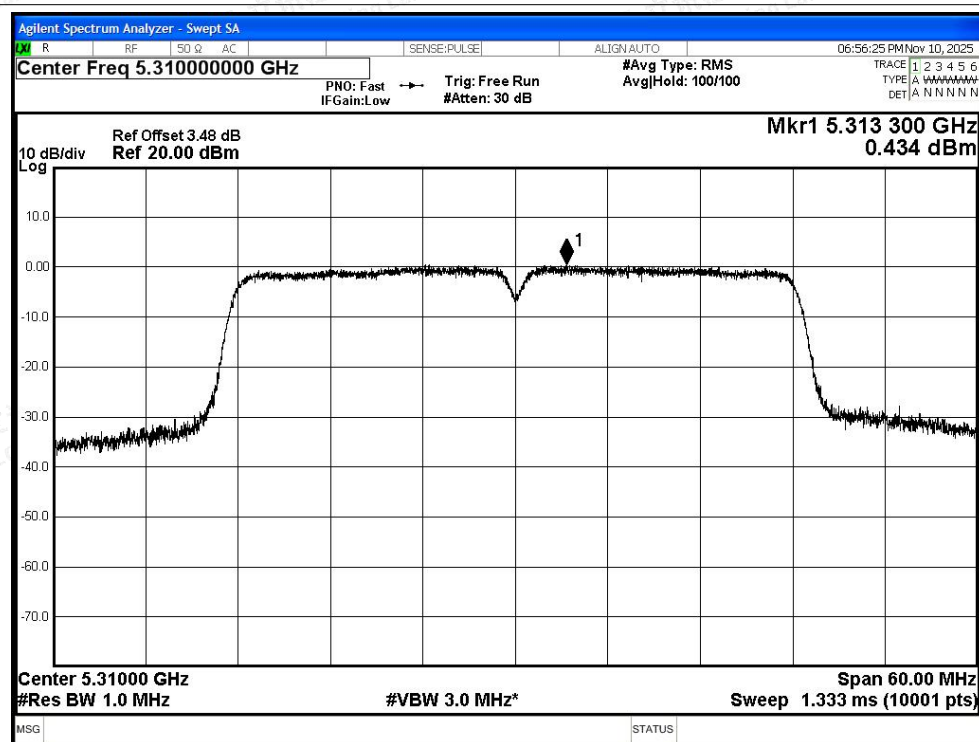

PSD NVNT ac80 5290MHz Ant2

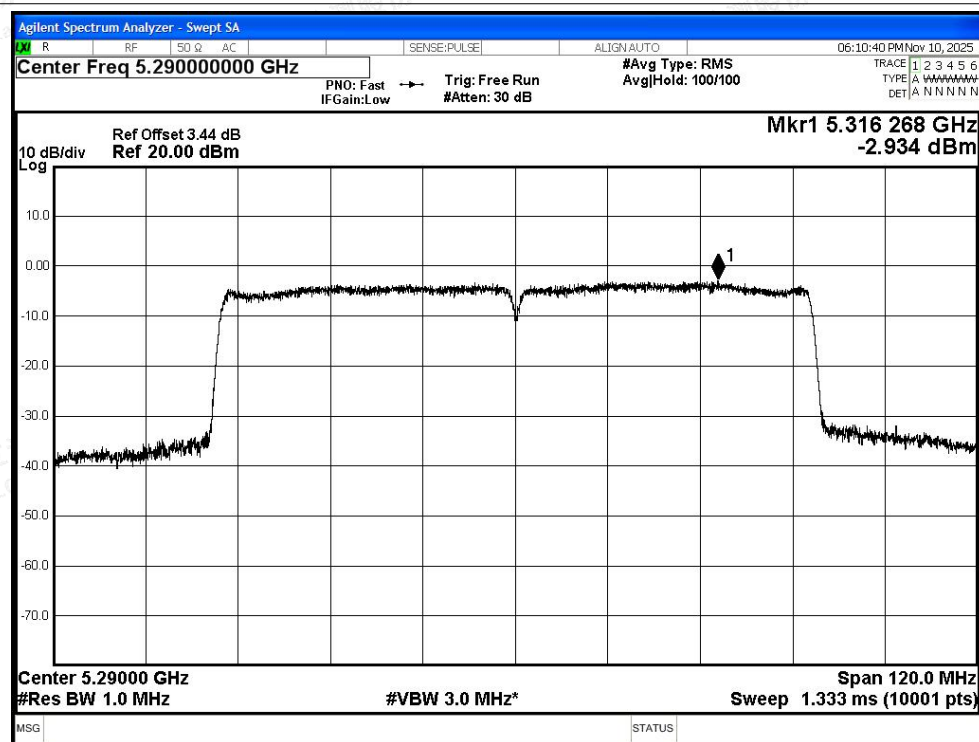

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ax20 5260MHz Ant2

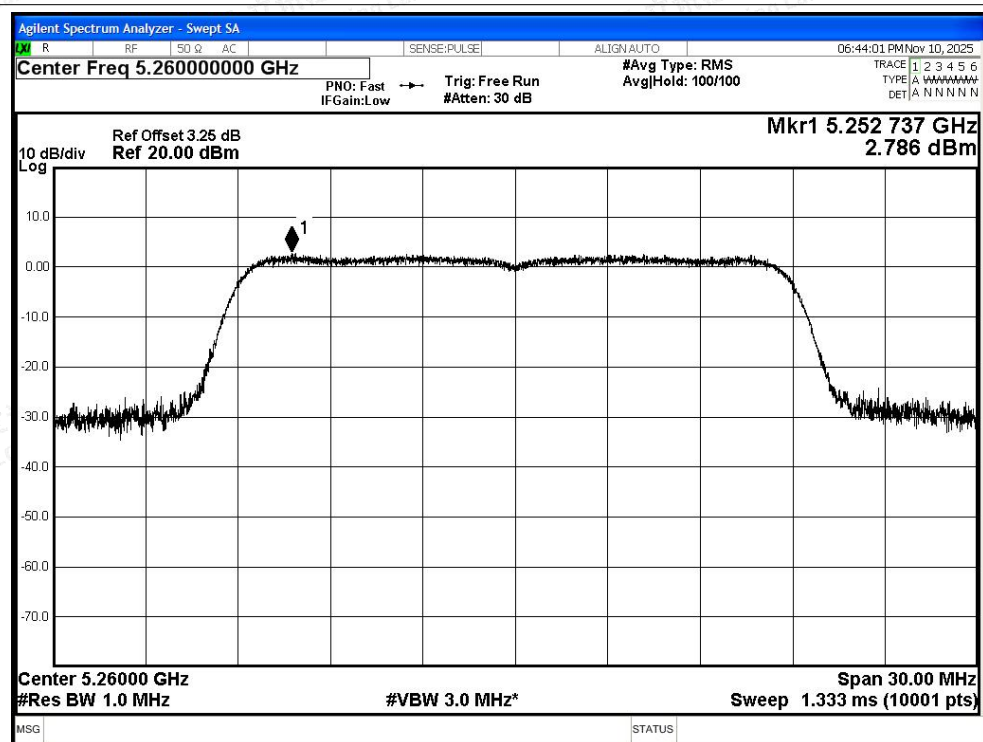

PSD NVNT ax20 5300MHz Ant2

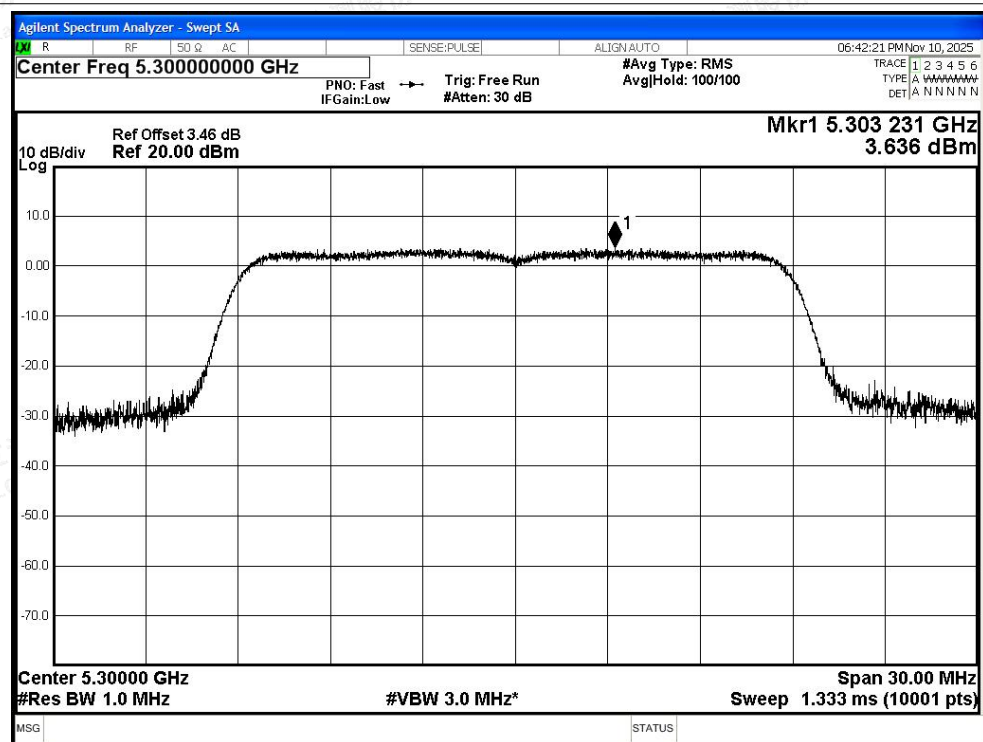

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ax20 5320MHz Ant2

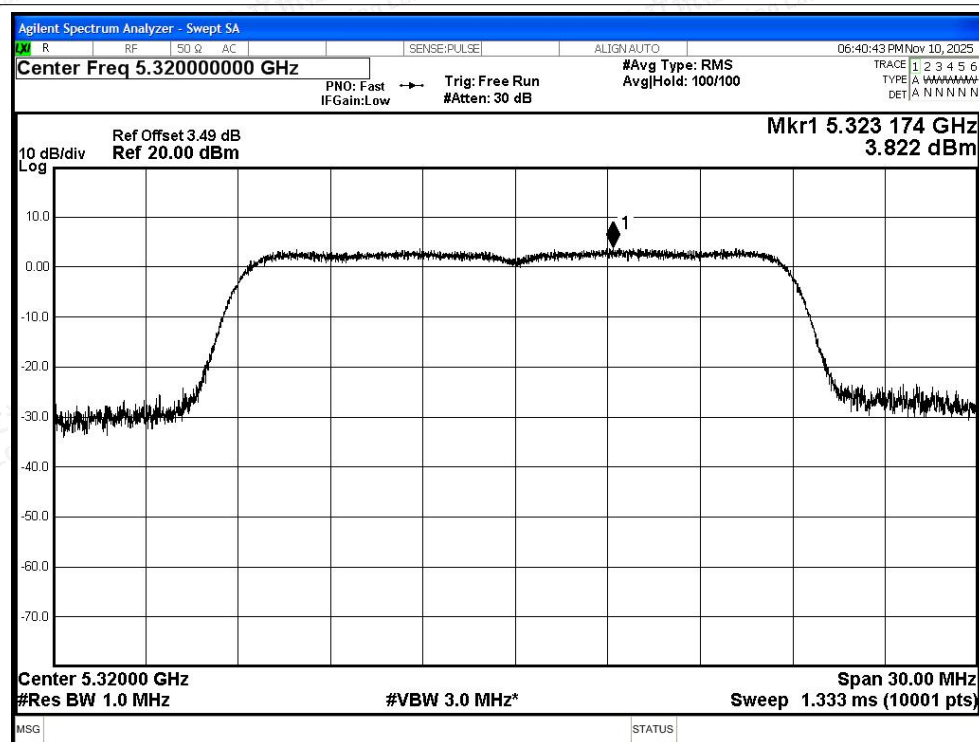

PSD NVNT ax40 5270MHz Ant2

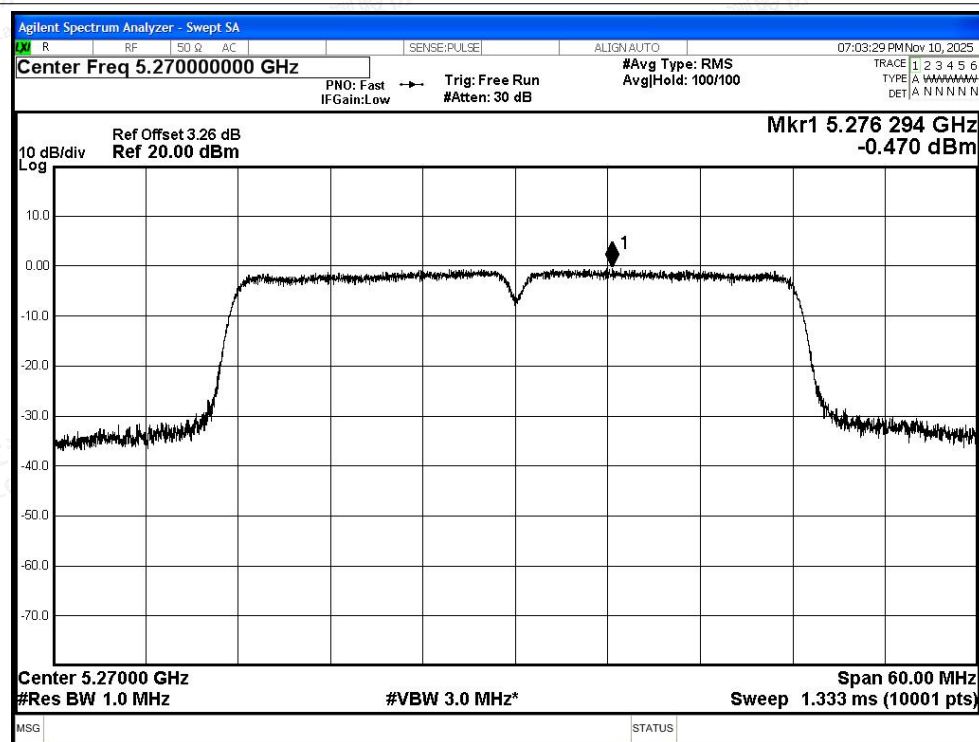

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ax40 5310MHz Ant2

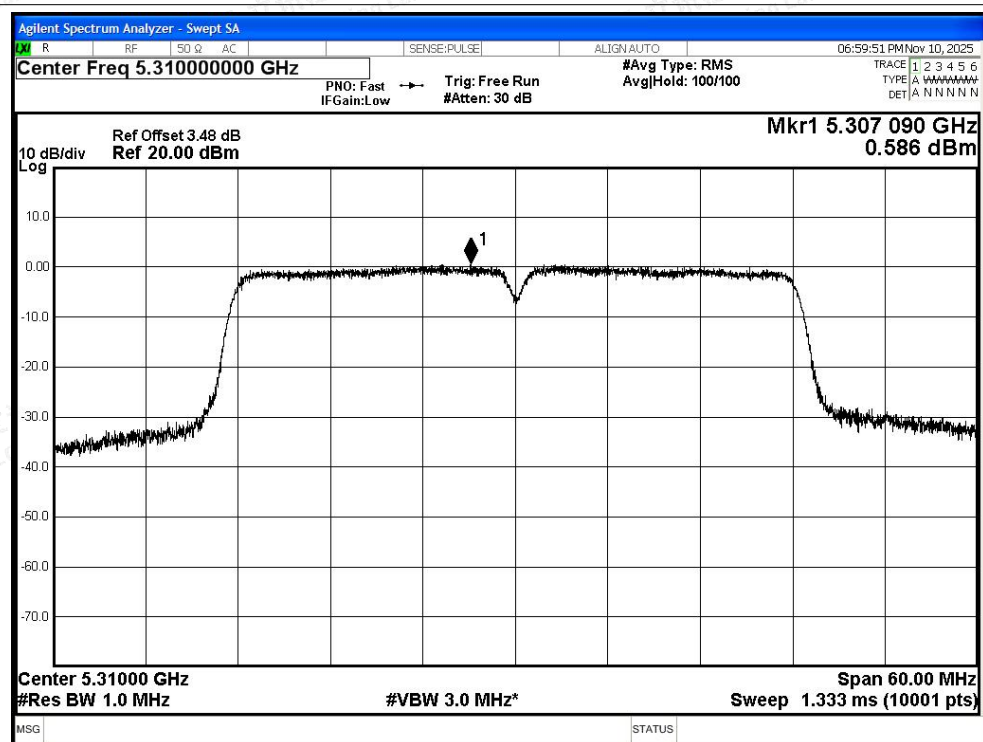

PSD NVNT ax80 5290MHz Ant2

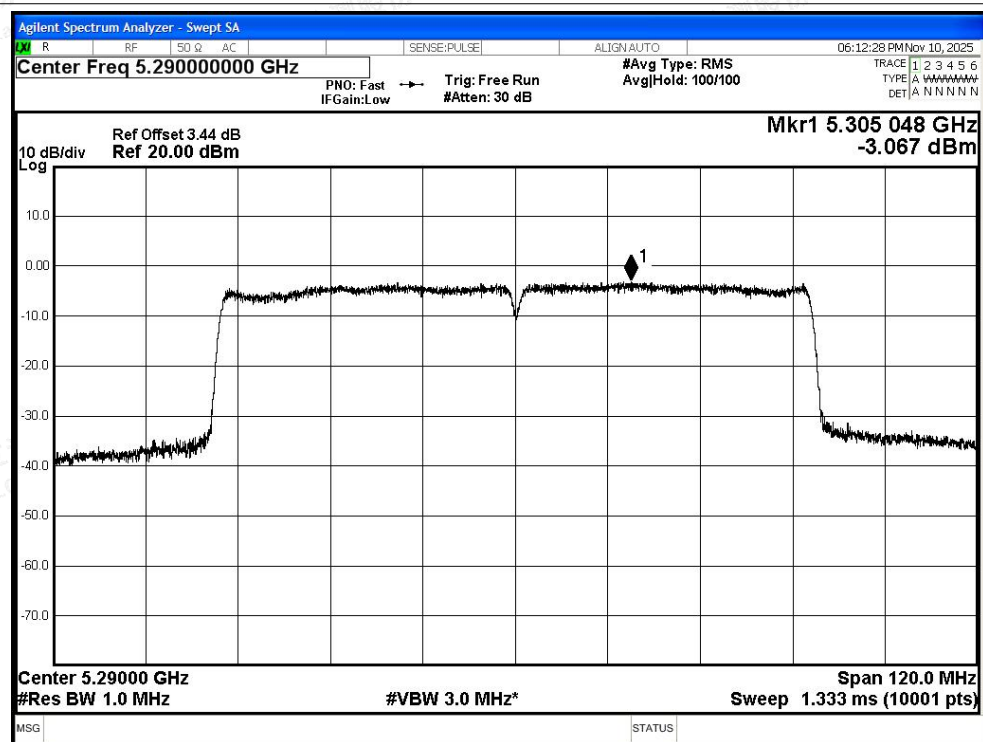

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



## E.4 Restrict Band

| Condition | Mode | Frequency (MHz) | Antenna | Spur Freq (MHz) | Power (dBm) | Gain (dBi) | Duty Factor (dB) | E (dBuV/m) | Detector | Limit (dBuV/m) | Verdict |
|-----------|------|-----------------|---------|-----------------|-------------|------------|------------------|------------|----------|----------------|---------|
| NVNT      | a    | 5260            | Ant1    | 4500            | -49.79      | 4.55       | -                | 49.99      | Peak     | 68.2           | Pass    |
| NVNT      | a    | 5260            | Ant1    | 4500            | -58.8       | 4.55       | 0.1              | 41.08      | Average  | 54             | Pass    |
| NVNT      | a    | 5260            | Ant1    | 5090.46         | -46.24      | 4.55       | -                | 53.54      | Peak     | 68.2           | Pass    |
| NVNT      | a    | 5260            | Ant1    | 5130.24         | -56.35      | 4.55       | 0.1              | 43.53      | Average  | 54             | Pass    |
| NVNT      | a    | 5260            | Ant1    | 5150            | -49.04      | 4.55       | -                | 50.74      | Peak     | 68.2           | Pass    |
| NVNT      | a    | 5260            | Ant1    | 5150            | -56.91      | 4.55       | 0.1              | 42.97      | Average  | 54             | Pass    |
| NVNT      | a    | 5320            | Ant1    | 5350            | -42.49      | 4.55       | -                | 57.29      | Peak     | 68.2           | Pass    |
| NVNT      | a    | 5320            | Ant1    | 5350            | -54.76      | 4.55       | 0.1              | 45.12      | Average  | 54             | Pass    |
| NVNT      | a    | 5320            | Ant1    | 5350.2          | -41.58      | 4.55       | -                | 58.20      | Peak     | 68.2           | Pass    |
| NVNT      | a    | 5320            | Ant1    | 5350            | -54.76      | 4.55       | 0.1              | 45.12      | Average  | 54             | Pass    |
| NVNT      | a    | 5320            | Ant1    | 5460            | -50.24      | 4.55       | -                | 49.54      | Peak     | 68.2           | Pass    |
| NVNT      | a    | 5320            | Ant1    | 5460            | -57.04      | 4.55       | 0.1              | 42.84      | Average  | 54             | Pass    |
| NVNT      | n20  | 5260            | Ant1    | 4500            | -50.98      | 4.55       | -                | 48.80      | Peak     | 68.2           | Pass    |
| NVNT      | n20  | 5260            | Ant1    | 4500            | -58.46      | 4.55       | 0.12             | 41.44      | Average  | 54             | Pass    |
| NVNT      | n20  | 5260            | Ant1    | 4805.76         | -46.56      | 4.55       | -                | 53.22      | Peak     | 68.2           | Pass    |
| NVNT      | n20  | 5260            | Ant1    | 4787.82         | -56.3       | 4.55       | 0.12             | 43.60      | Average  | 54             | Pass    |
| NVNT      | n20  | 5260            | Ant1    | 5150            | -48.68      | 4.55       | -                | 51.10      | Peak     | 68.2           | Pass    |
| NVNT      | n20  | 5260            | Ant1    | 5150            | -56.69      | 4.55       | 0.12             | 43.21      | Average  | 54             | Pass    |
| NVNT      | n20  | 5320            | Ant1    | 5350            | -41.94      | 4.55       | -                | 57.84      | Peak     | 68.2           | Pass    |
| NVNT      | n20  | 5320            | Ant1    | 5350            | -53.43      | 4.55       | 0.12             | 46.47      | Average  | 54             | Pass    |
| NVNT      | n20  | 5320            | Ant1    | 5353.2          | -39.16      | 4.55       | -                | 60.62      | Peak     | 68.2           | Pass    |
| NVNT      | n20  | 5320            | Ant1    | 5350            | -53.43      | 4.55       | 0.12             | 46.47      | Average  | 54             | Pass    |
| NVNT      | n20  | 5320            | Ant1    | 5460            | -48.39      | 4.55       | -                | 51.39      | Peak     | 68.2           | Pass    |
| NVNT      | n20  | 5320            | Ant1    | 5460            | -57.69      | 4.55       | 0.12             | 42.21      | Average  | 54             | Pass    |
| NVNT      | n40  | 5270            | Ant1    | 4500            | -50.47      | 4.55       | -                | 49.31      | Peak     | 68.2           | Pass    |
| NVNT      | n40  | 5270            | Ant1    | 4500            | -58.73      | 4.55       | 0.23             | 41.28      | Average  | 54             | Pass    |
| NVNT      | n40  | 5270            | Ant1    | 5075.1          | -45.61      | 4.55       | -                | 54.17      | Peak     | 68.2           | Pass    |
| NVNT      | n40  | 5270            | Ant1    | 4806.99         | -54.06      | 4.55       | 0.23             | 45.95      | Average  | 54             | Pass    |
| NVNT      | n40  | 5270            | Ant1    | 5150            | -48.35      | 4.55       | -                | 51.43      | Peak     | 68.2           | Pass    |
| NVNT      | n40  | 5270            | Ant1    | 5150            | -57.05      | 4.55       | 0.23             | 42.96      | Average  | 54             | Pass    |
| NVNT      | n40  | 5310            | Ant1    | 5350            | -39.39      | 4.55       | -                | 60.39      | Peak     | 68.2           | Pass    |
| NVNT      | n40  | 5310            | Ant1    | 5350            | -53.64      | 4.55       | 0.24             | 46.38      | Average  | 54             | Pass    |
| NVNT      | n40  | 5310            | Ant1    | 5350            | -39.39      | 4.55       | -                | 60.39      | Peak     | 68.2           | Pass    |
| NVNT      | n40  | 5310            | Ant1    | 5351.2          | -53.14      | 4.55       | 0.24             | 46.88      | Average  | 54             | Pass    |
| NVNT      | n40  | 5310            | Ant1    | 5460            | -50.21      | 4.55       | -                | 49.57      | Peak     | 68.2           | Pass    |
| NVNT      | n40  | 5310            | Ant1    | 5460            | -57.62      | 4.55       | 0.24             | 42.40      | Average  | 54             | Pass    |
| NVNT      | ac20 | 5260            | Ant1    | 4500            | -51.54      | 4.55       | -                | 48.24      | Peak     | 68.2           | Pass    |
| NVNT      | ac20 | 5260            | Ant1    | 4500            | -59.09      | 4.55       | 0.12             | 40.81      | Average  | 54             | Pass    |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



|      |      |      |      |         |        |      |      |       |         |      |      |
|------|------|------|------|---------|--------|------|------|-------|---------|------|------|
| NVNT | ac20 | 5260 | Ant1 | 5035.86 | -45.61 | 4.55 | -    | 54.17 | Peak    | 68.2 | Pass |
| NVNT | ac20 | 5260 | Ant1 | 4772.22 | -56.13 | 4.55 | 0.12 | 43.77 | Average | 54   | Pass |
| NVNT | ac20 | 5260 | Ant1 | 5150    | -48.44 | 4.55 | -    | 51.34 | Peak    | 68.2 | Pass |
| NVNT | ac20 | 5260 | Ant1 | 5150    | -56.79 | 4.55 | 0.12 | 43.11 | Average | 54   | Pass |
| NVNT | ac20 | 5320 | Ant1 | 5350    | -43.63 | 4.55 | -    | 56.15 | Peak    | 68.2 | Pass |
| NVNT | ac20 | 5320 | Ant1 | 5350    | -53.64 | 4.55 | 0.12 | 46.26 | Average | 54   | Pass |
| NVNT | ac20 | 5320 | Ant1 | 5350.4  | -37.65 | 4.55 | -    | 62.13 | Peak    | 68.2 | Pass |
| NVNT | ac20 | 5320 | Ant1 | 5351.2  | -53.12 | 4.55 | 0.12 | 46.78 | Average | 54   | Pass |
| NVNT | ac20 | 5320 | Ant1 | 5460    | -48.79 | 4.55 | -    | 50.99 | Peak    | 68.2 | Pass |
| NVNT | ac20 | 5320 | Ant1 | 5460    | -57.37 | 4.55 | 0.12 | 42.53 | Average | 54   | Pass |
| NVNT | ac40 | 5270 | Ant1 | 4500    | -50.42 | 4.55 | -    | 49.36 | Peak    | 68.2 | Pass |
| NVNT | ac40 | 5270 | Ant1 | 4500    | -58.5  | 4.55 | 0.23 | 41.51 | Average | 54   | Pass |
| NVNT | ac40 | 5270 | Ant1 | 4772.97 | -45.15 | 4.55 | -    | 54.63 | Peak    | 68.2 | Pass |
| NVNT | ac40 | 5270 | Ant1 | 4806.18 | -54.48 | 4.55 | 0.23 | 45.53 | Average | 54   | Pass |
| NVNT | ac40 | 5270 | Ant1 | 5150    | -48.3  | 4.55 | -    | 51.48 | Peak    | 68.2 | Pass |
| NVNT | ac40 | 5270 | Ant1 | 5150    | -57.09 | 4.55 | 0.23 | 42.92 | Average | 54   | Pass |
| NVNT | ac40 | 5310 | Ant1 | 5350    | -40.86 | 4.55 | -    | 58.92 | Peak    | 68.2 | Pass |
| NVNT | ac40 | 5310 | Ant1 | 5350    | -53.31 | 4.55 | 0.23 | 46.70 | Average | 54   | Pass |
| NVNT | ac40 | 5310 | Ant1 | 5350.6  | -39.5  | 4.55 | -    | 60.28 | Peak    | 68.2 | Pass |
| NVNT | ac40 | 5310 | Ant1 | 5350    | -53.31 | 4.55 | 0.23 | 46.70 | Average | 54   | Pass |
| NVNT | ac40 | 5310 | Ant1 | 5460    | -49.24 | 4.55 | -    | 50.54 | Peak    | 68.2 | Pass |
| NVNT | ac40 | 5310 | Ant1 | 5460    | -57.79 | 4.55 | 0.23 | 42.22 | Average | 54   | Pass |
| NVNT | ac80 | 5290 | Ant1 | 4500    | -50    | 4.55 | -    | 49.78 | Peak    | 68.2 | Pass |
| NVNT | ac80 | 5290 | Ant1 | 4500    | -58.81 | 4.55 | 0.47 | 41.44 | Average | 54   | Pass |
| NVNT | ac80 | 5290 | Ant1 | 5129.01 | -46.34 | 4.55 | -    | 53.44 | Peak    | 68.2 | Pass |
| NVNT | ac80 | 5290 | Ant1 | 5109    | -56.18 | 4.55 | 0.47 | 44.07 | Average | 54   | Pass |
| NVNT | ac80 | 5290 | Ant1 | 5150    | -48.46 | 4.55 | -    | 51.32 | Peak    | 68.2 | Pass |
| NVNT | ac80 | 5290 | Ant1 | 5150    | -56.38 | 4.55 | 0.47 | 43.87 | Average | 54   | Pass |
| NVNT | ac80 | 5290 | Ant1 | 5350    | -45.5  | 4.55 | -    | 54.28 | Peak    | 68.2 | Pass |
| NVNT | ac80 | 5290 | Ant1 | 5350    | -53.92 | 4.55 | 0.47 | 46.33 | Average | 54   | Pass |
| NVNT | ac80 | 5290 | Ant1 | 5351.5  | -42.65 | 4.55 | -    | 57.13 | Peak    | 68.2 | Pass |
| NVNT | ac80 | 5290 | Ant1 | 5350.75 | -53.61 | 4.55 | 0.47 | 46.64 | Average | 54   | Pass |
| NVNT | ac80 | 5290 | Ant1 | 5460    | -49.17 | 4.55 | -    | 50.61 | Peak    | 68.2 | Pass |
| NVNT | ac80 | 5290 | Ant1 | 5460    | -57.28 | 4.55 | 0.47 | 42.97 | Average | 54   | Pass |
| NVNT | ax20 | 5260 | Ant1 | 4500    | -49.82 | 4.55 | -    | 49.96 | Peak    | 68.2 | Pass |
| NVNT | ax20 | 5260 | Ant1 | 4500    | -58.86 | 4.55 | 0.12 | 41.04 | Average | 54   | Pass |
| NVNT | ax20 | 5260 | Ant1 | 4683.3  | -46.26 | 4.55 | -    | 53.52 | Peak    | 68.2 | Pass |
| NVNT | ax20 | 5260 | Ant1 | 4772.22 | -55.58 | 4.55 | 0.12 | 44.32 | Average | 54   | Pass |
| NVNT | ax20 | 5260 | Ant1 | 5150    | -46.46 | 4.55 | -    | 53.32 | Peak    | 68.2 | Pass |
| NVNT | ax20 | 5260 | Ant1 | 5150    | -56.41 | 4.55 | 0.12 | 43.49 | Average | 54   | Pass |
| NVNT | ax20 | 5320 | Ant1 | 5350    | -38.38 | 4.55 | -    | 61.40 | Peak    | 68.2 | Pass |
| NVNT | ax20 | 5320 | Ant1 | 5350    | -54.23 | 4.55 | 0.12 | 45.67 | Average | 54   | Pass |
| NVNT | ax20 | 5320 | Ant1 | 5350    | -38.38 | 4.55 | -    | 61.40 | Peak    | 68.2 | Pass |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



|      |      |      |      |         |        |      |      |       |         |      |      |
|------|------|------|------|---------|--------|------|------|-------|---------|------|------|
| NVNT | ax20 | 5320 | Ant1 | 5351.2  | -53.59 | 4.55 | 0.12 | 46.31 | Average | 54   | Pass |
| NVNT | ax20 | 5320 | Ant1 | 5460    | -48    | 4.55 | -    | 51.78 | Peak    | 68.2 | Pass |
| NVNT | ax20 | 5320 | Ant1 | 5460    | -57.44 | 4.55 | 0.12 | 42.46 | Average | 54   | Pass |
| NVNT | ax40 | 5270 | Ant1 | 4500    | -48.94 | 4.55 | -    | 50.84 | Peak    | 68.2 | Pass |
| NVNT | ax40 | 5270 | Ant1 | 4500    | -58.51 | 4.55 | 0.24 | 41.51 | Average | 54   | Pass |
| NVNT | ax40 | 5270 | Ant1 | 4802.13 | -45.1  | 4.55 | -    | 54.68 | Peak    | 68.2 | Pass |
| NVNT | ax40 | 5270 | Ant1 | 4806.99 | -54.13 | 4.55 | 0.24 | 45.89 | Average | 54   | Pass |
| NVNT | ax40 | 5270 | Ant1 | 5150    | -47.11 | 4.55 | -    | 52.67 | Peak    | 68.2 | Pass |
| NVNT | ax40 | 5270 | Ant1 | 5150    | -57.01 | 4.55 | 0.24 | 43.01 | Average | 54   | Pass |
| NVNT | ax40 | 5310 | Ant1 | 5350    | -44.1  | 4.55 | -    | 55.68 | Peak    | 68.2 | Pass |
| NVNT | ax40 | 5310 | Ant1 | 5350    | -53.6  | 4.55 | 0.24 | 46.42 | Average | 54   | Pass |
| NVNT | ax40 | 5310 | Ant1 | 5351.2  | -40.78 | 4.55 | -    | 59.00 | Peak    | 68.2 | Pass |
| NVNT | ax40 | 5310 | Ant1 | 5350.8  | -52.77 | 4.55 | 0.24 | 47.25 | Average | 54   | Pass |
| NVNT | ax40 | 5310 | Ant1 | 5460    | -49.96 | 4.55 | -    | 49.82 | Peak    | 68.2 | Pass |
| NVNT | ax40 | 5310 | Ant1 | 5460    | -57.61 | 4.55 | 0.24 | 42.41 | Average | 54   | Pass |
| NVNT | ax80 | 5290 | Ant1 | 5350    | -42.38 | 4.55 | -    | 57.40 | Peak    | 68.2 | Pass |
| NVNT | ax80 | 5290 | Ant1 | 5350    | -53.9  | 4.55 | 0.47 | 46.35 | Average | 54   | Pass |
| NVNT | ax80 | 5290 | Ant1 | 5362.5  | -39.49 | 4.55 | -    | 60.29 | Peak    | 68.2 | Pass |
| NVNT | ax80 | 5290 | Ant1 | 5353.75 | -53.69 | 4.55 | 0.47 | 46.56 | Average | 54   | Pass |
| NVNT | ax80 | 5290 | Ant1 | 5460    | -49.34 | 4.55 | -    | 50.44 | Peak    | 68.2 | Pass |
| NVNT | ax80 | 5290 | Ant1 | 5460    | -57.48 | 4.55 | 0.47 | 42.77 | Average | 54   | Pass |
| NVNT | ax80 | 5290 | Ant1 | 4500    | -50.3  | 4.55 | -    | 49.48 | Peak    | 68.2 | Pass |
| NVNT | ax80 | 5290 | Ant1 | 4500    | -58.33 | 4.55 | 0.47 | 41.92 | Average | 54   | Pass |
| NVNT | ax80 | 5290 | Ant1 | 4976.76 | -46.18 | 4.55 | -    | 53.60 | Peak    | 68.2 | Pass |
| NVNT | ax80 | 5290 | Ant1 | 5137.71 | -56.25 | 4.55 | 0.47 | 44.00 | Average | 54   | Pass |
| NVNT | ax80 | 5290 | Ant1 | 5150    | -48.45 | 4.55 | -    | 51.33 | Peak    | 68.2 | Pass |
| NVNT | ax80 | 5290 | Ant1 | 5150    | -56.53 | 4.55 | 0.47 | 43.72 | Average | 54   | Pass |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




## Test Graphs

## Restrict Band NVNT a 5260MHz Ant1 Peak

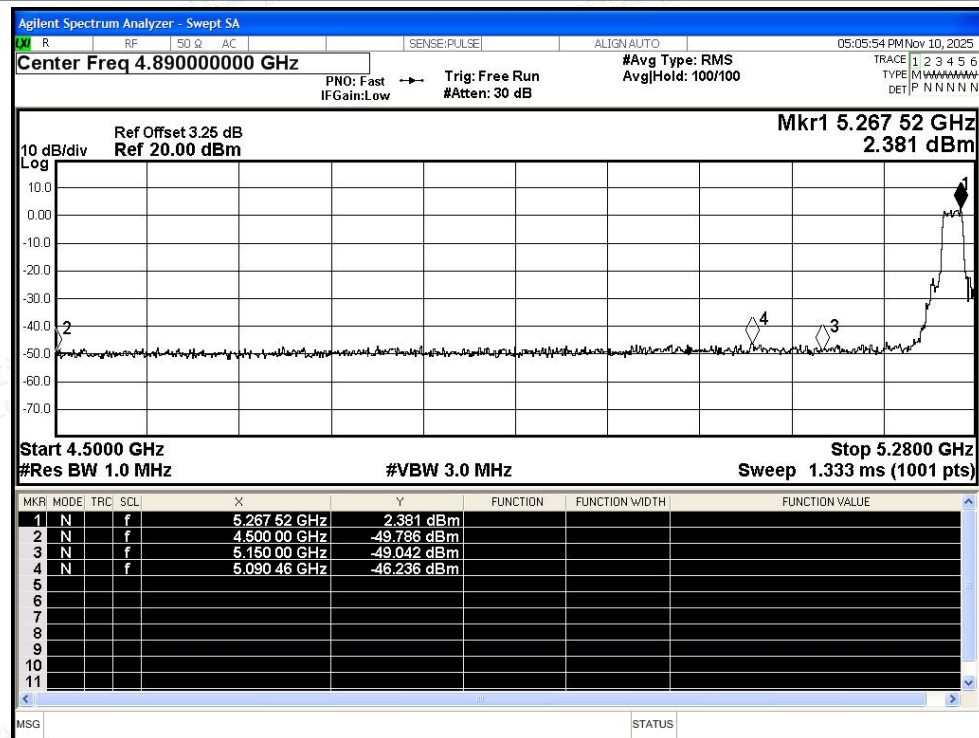

## Restrict Band NVNT a 5260MHz Ant1 Average

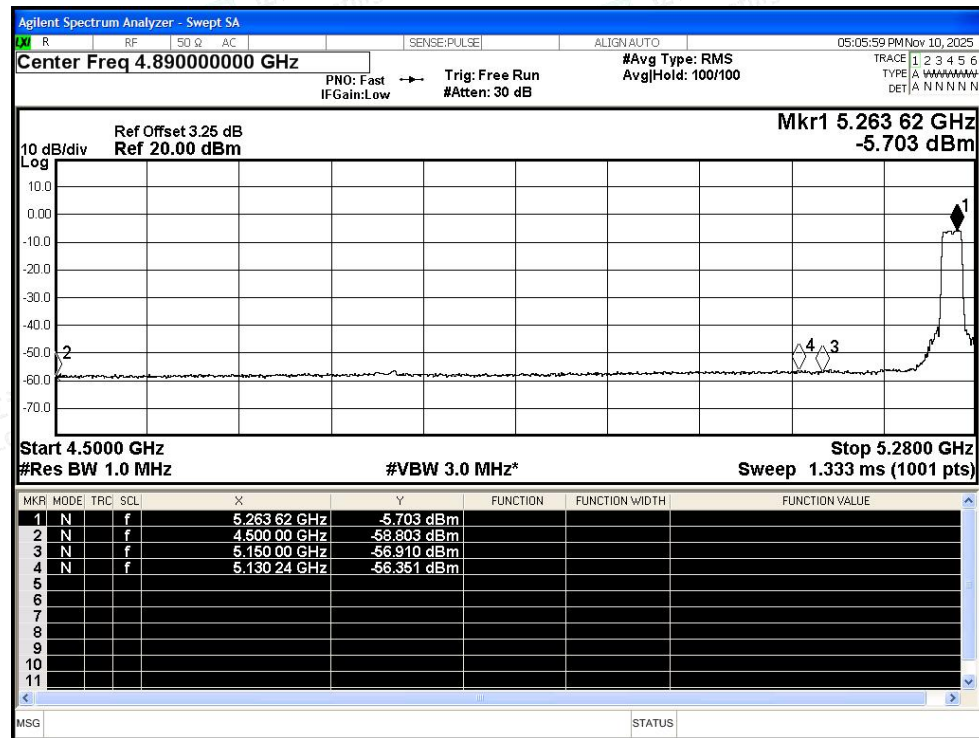

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT a 5320MHz Ant1 Peak

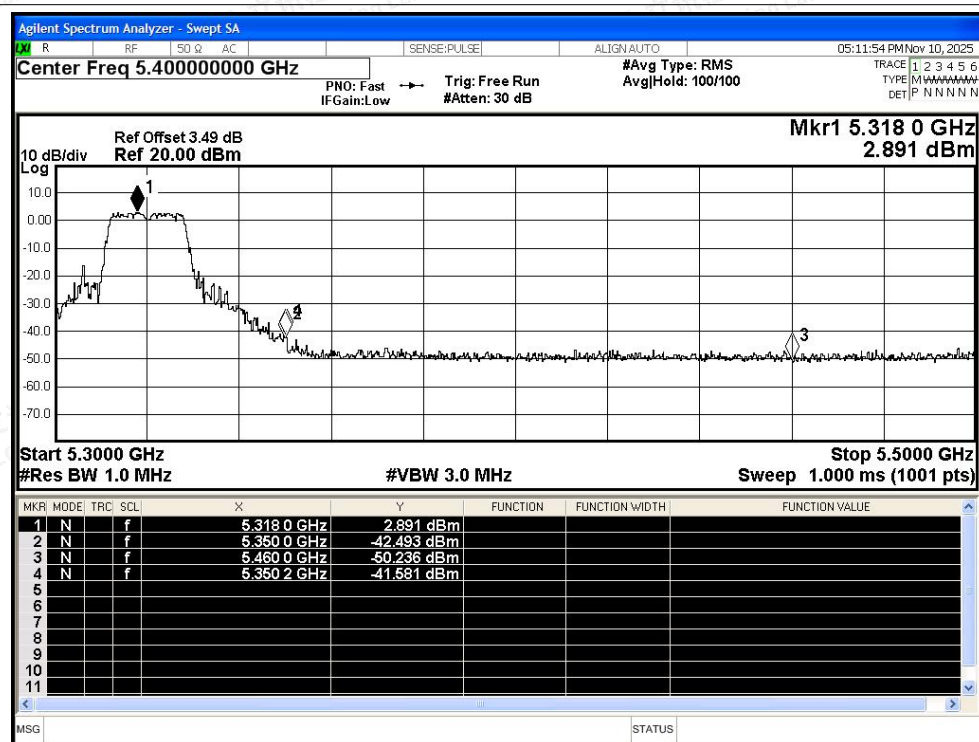

## Restrict Band NVNT a 5320MHz Ant1 Average

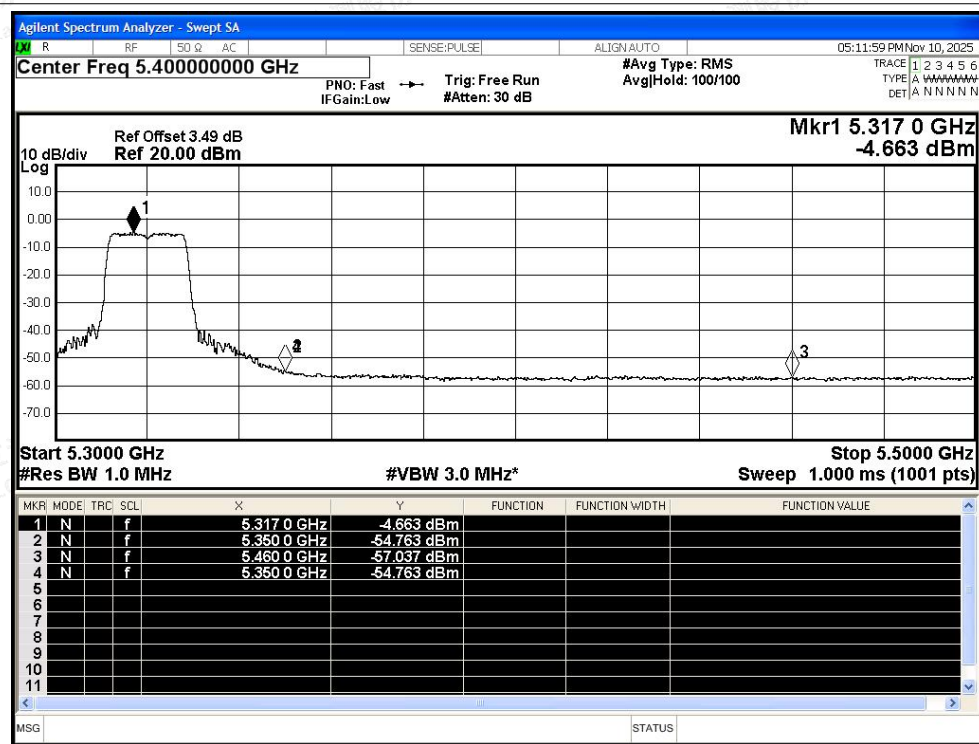

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT n20 5260MHz Ant1 Peak

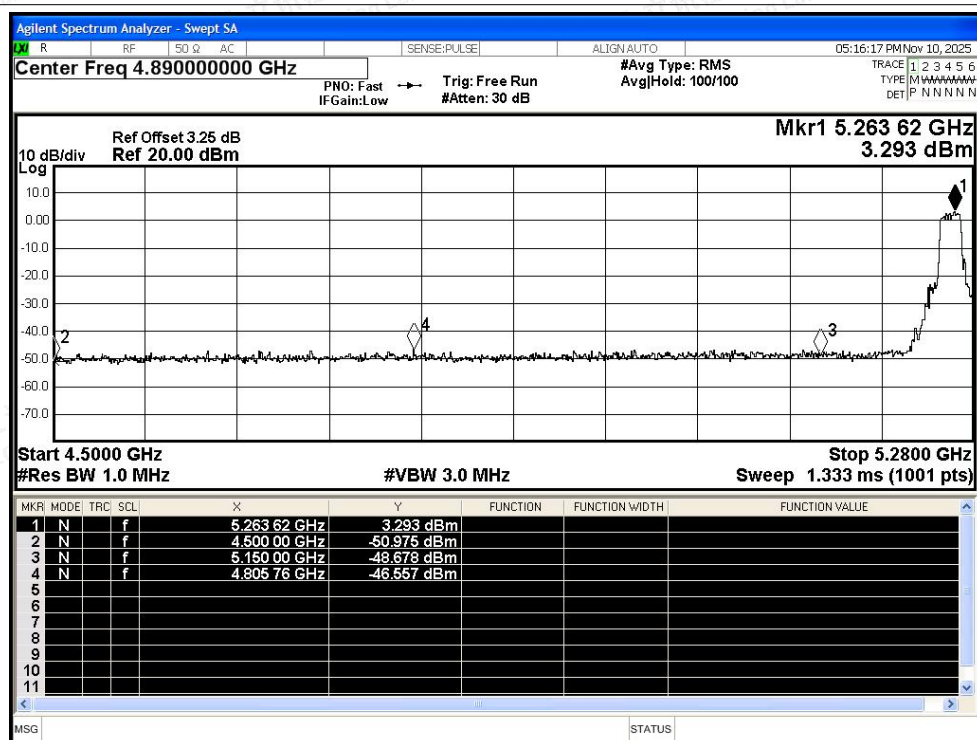

## Restrict Band NVNT n20 5260MHz Ant1 Average

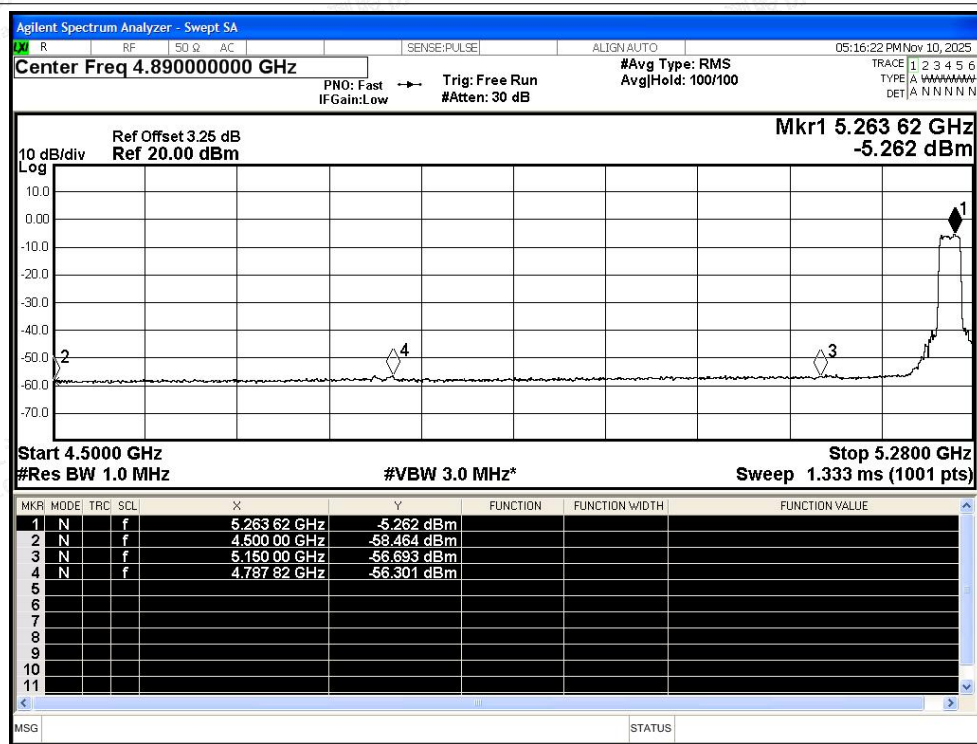

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT n20 5320MHz Ant1 Peak

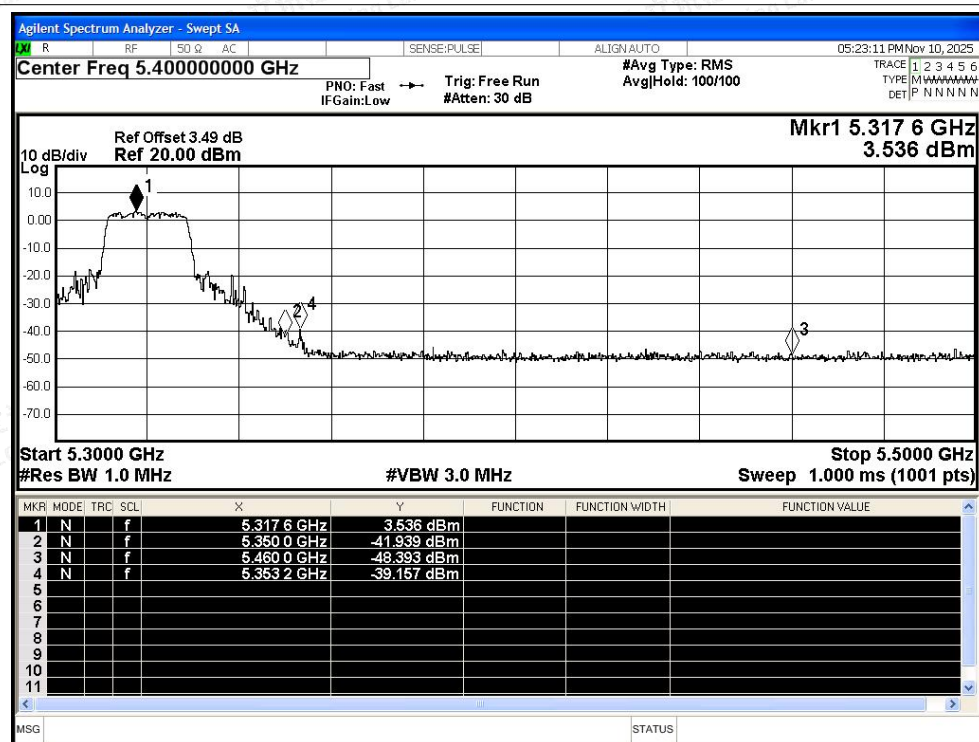

## Restrict Band NVNT n20 5320MHz Ant1 Average

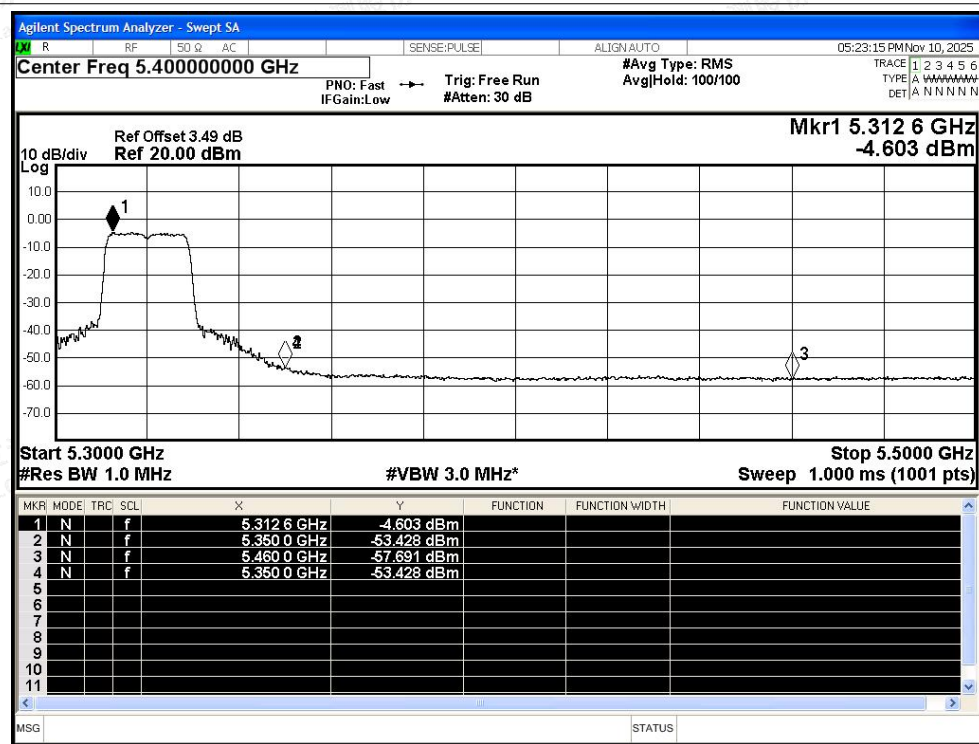

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT n40 5270MHz Ant1 Peak

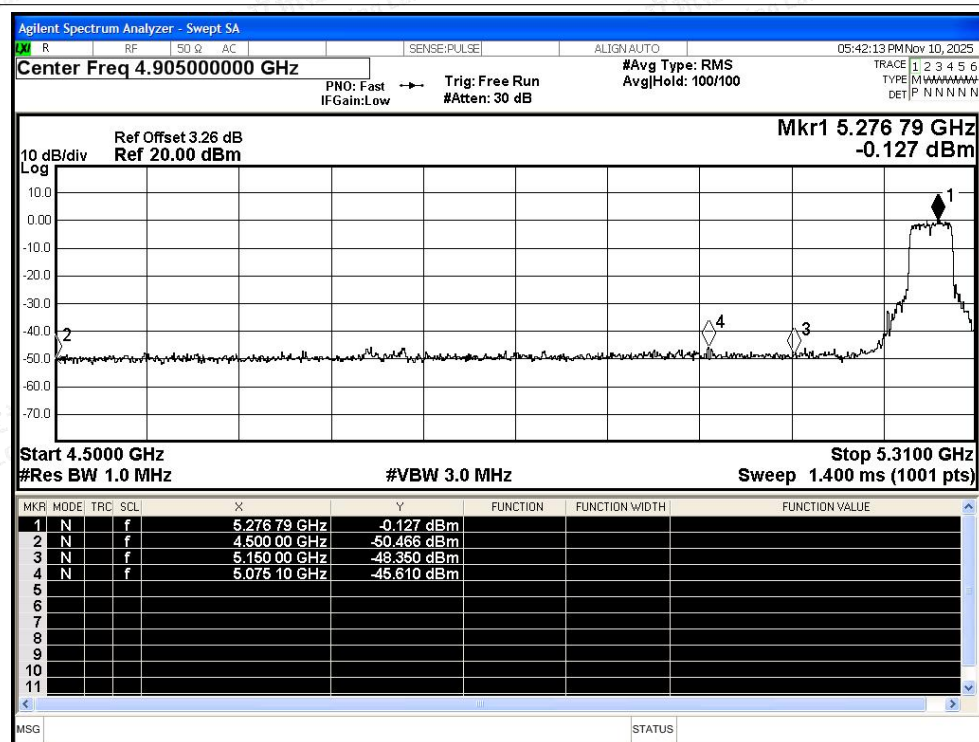

## Restrict Band NVNT n40 5270MHz Ant1 Average

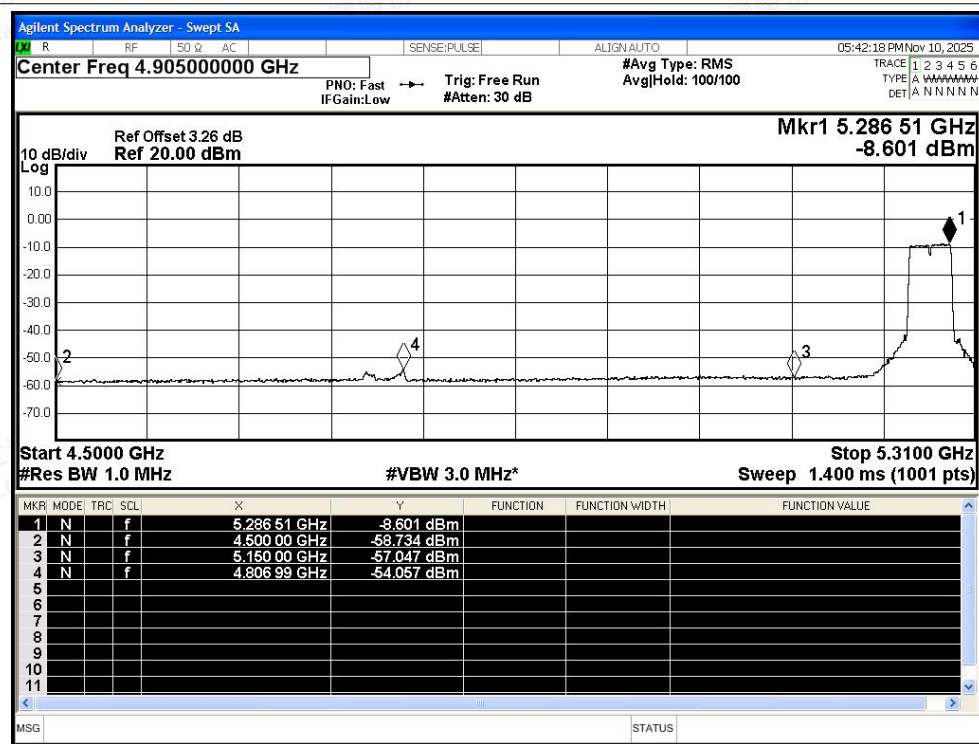

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity