





Restrict Band NVNT n40 5310MHz Ant1 Peak

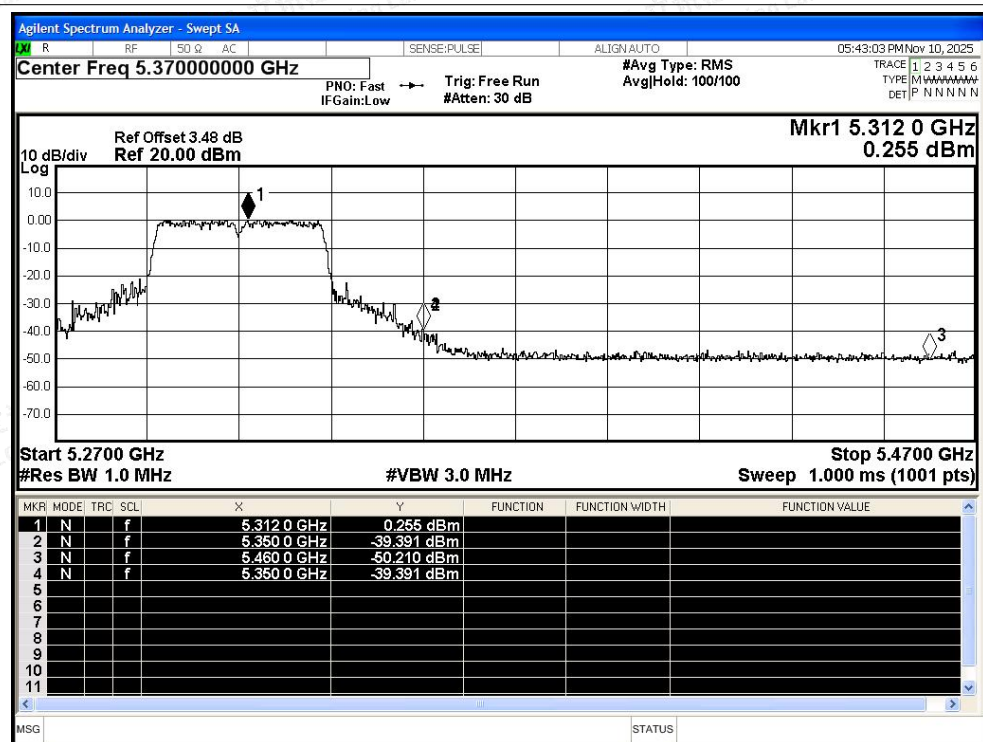

Restrict Band NVNT n40 5310MHz Ant1 Average

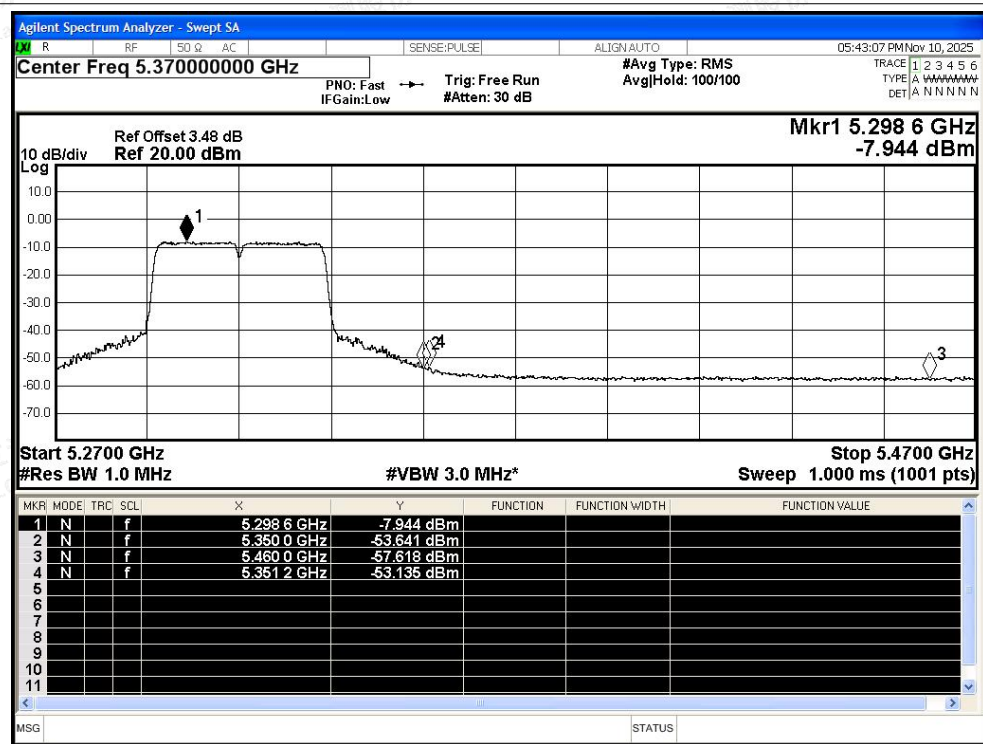

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5260MHz Ant1 Peak

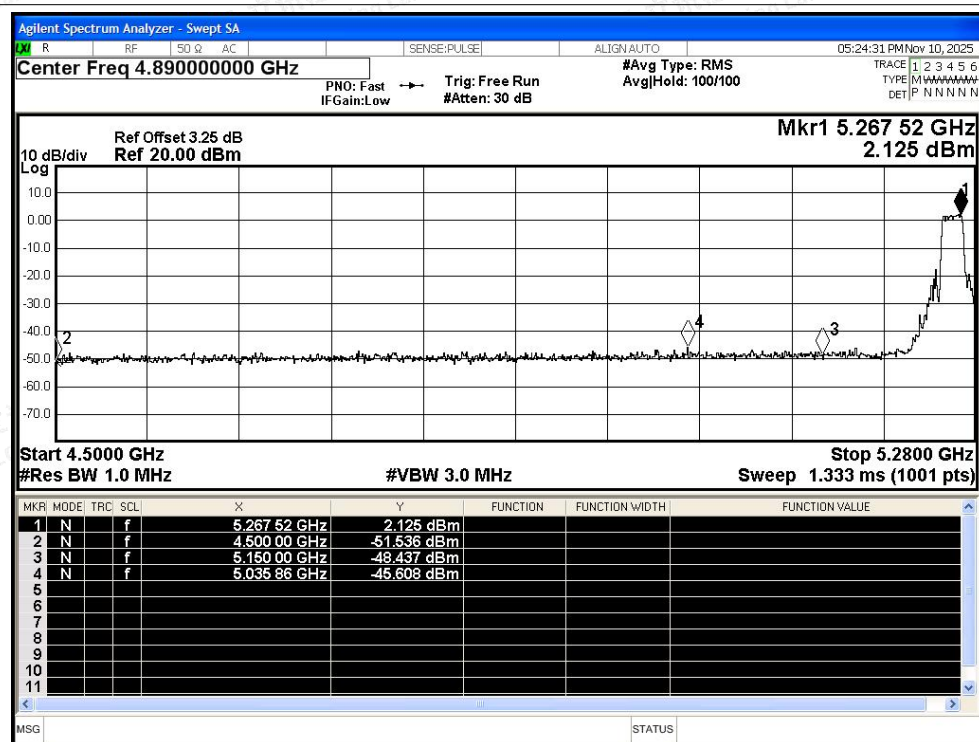

Restrict Band NVNT ac20 5260MHz Ant1 Average

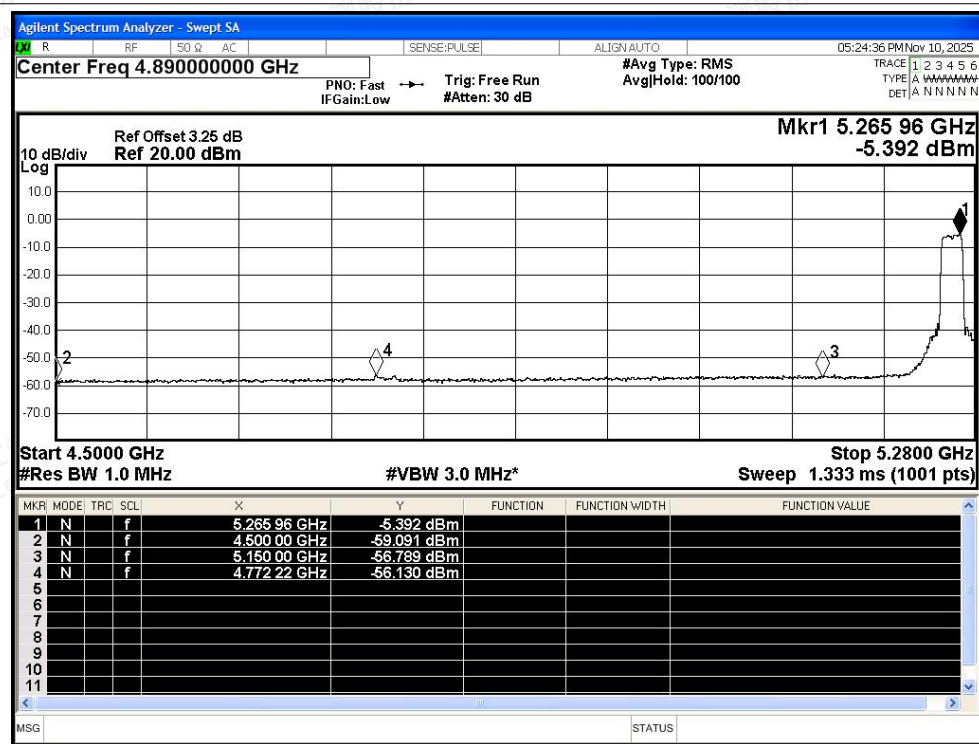

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5320MHz Ant1 Peak

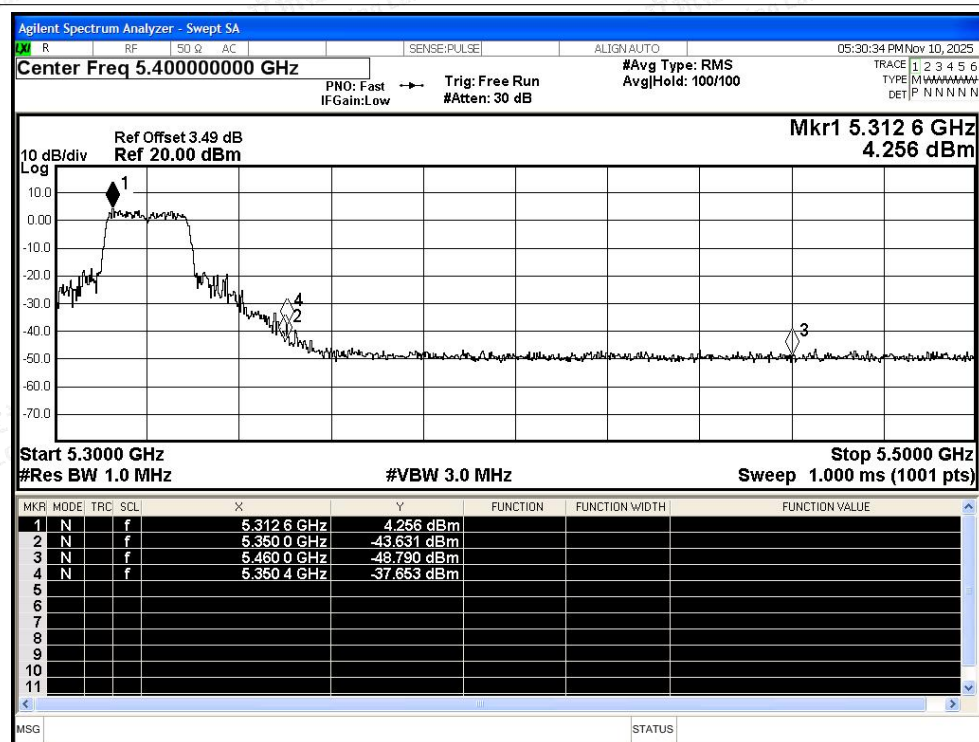

Restrict Band NVNT ac20 5320MHz Ant1 Average

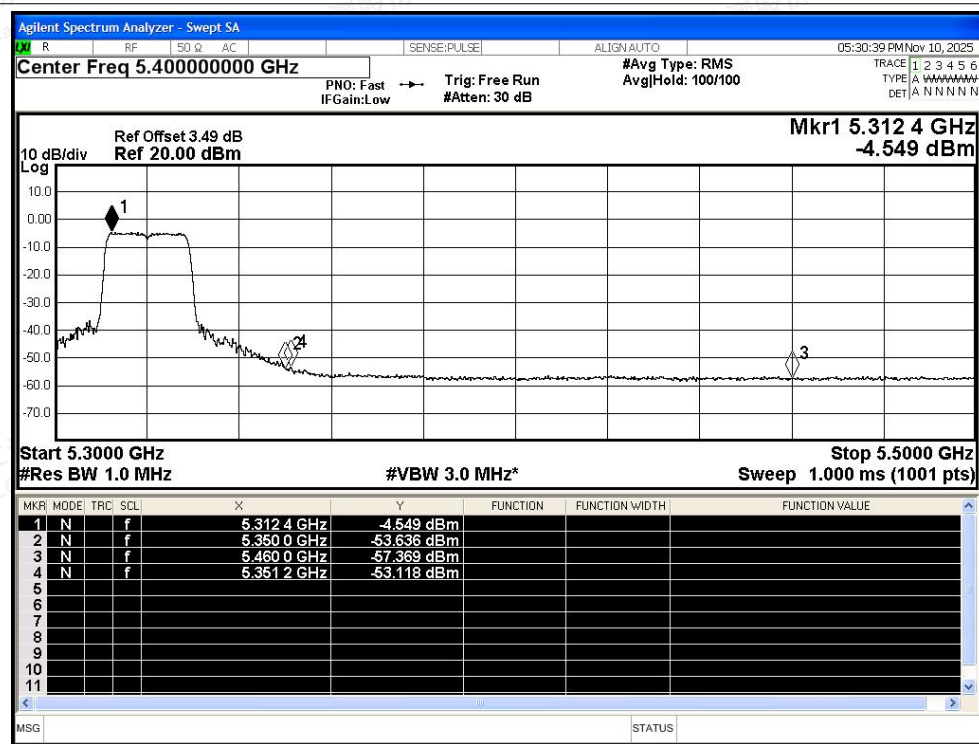

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5270MHz Ant1 Peak

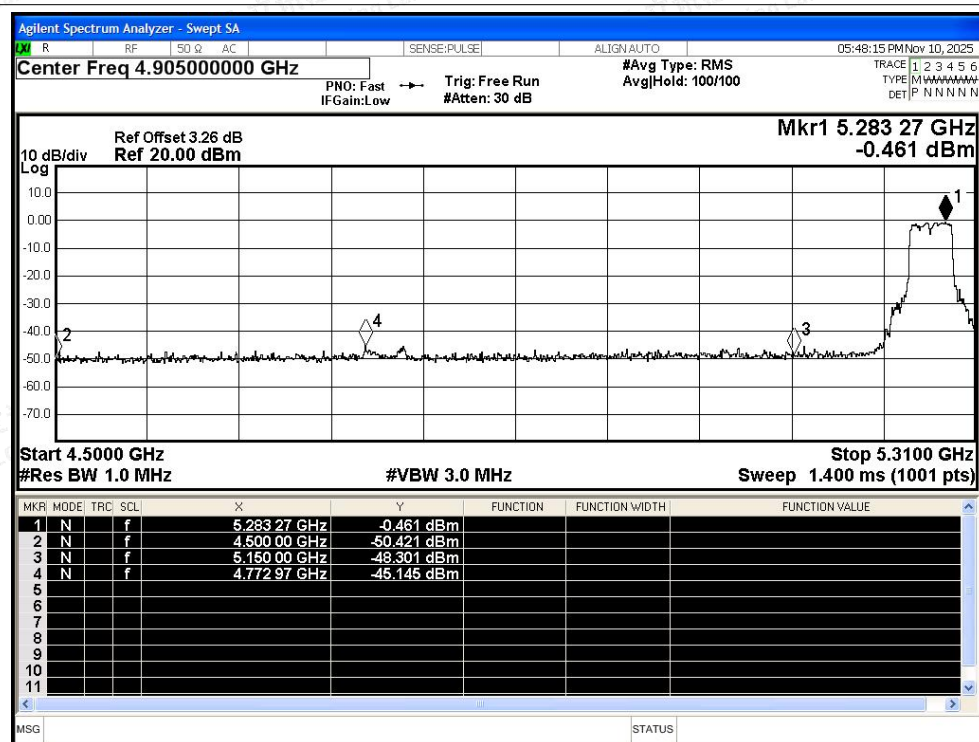

Restrict Band NVNT ac40 5270MHz Ant1 Average

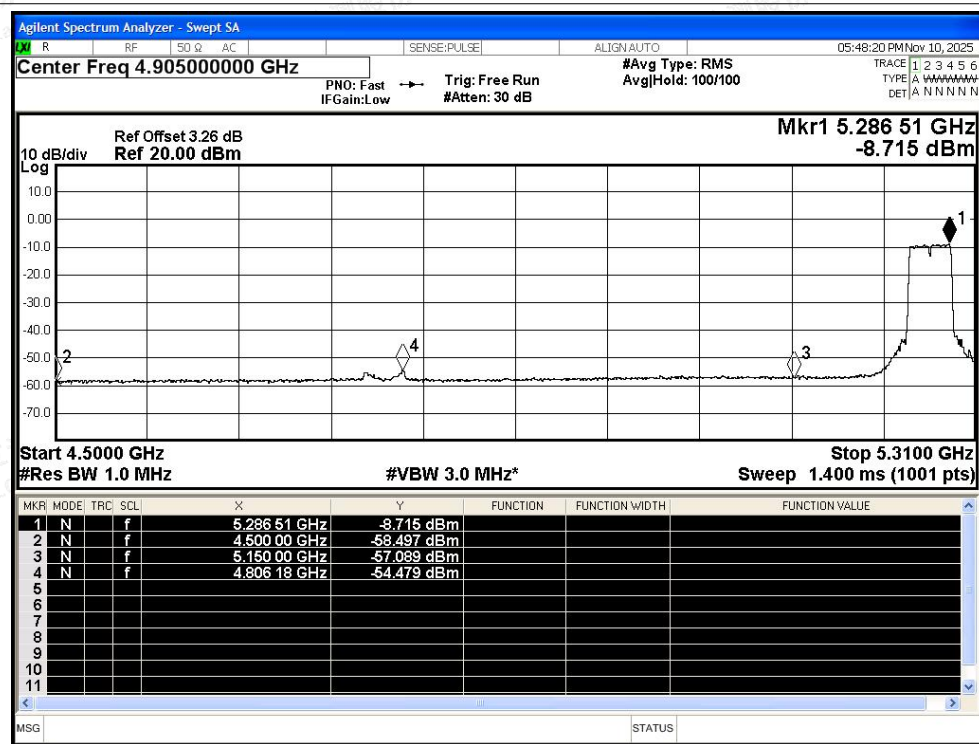

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5310MHz Ant1 Peak

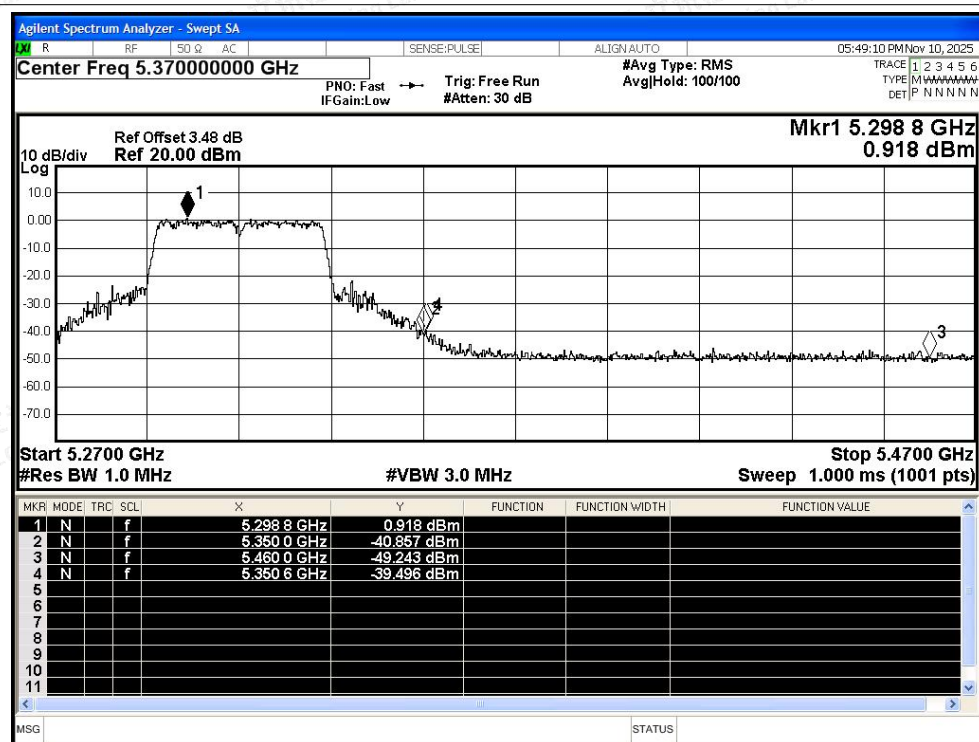

Restrict Band NVNT ac40 5310MHz Ant1 Average

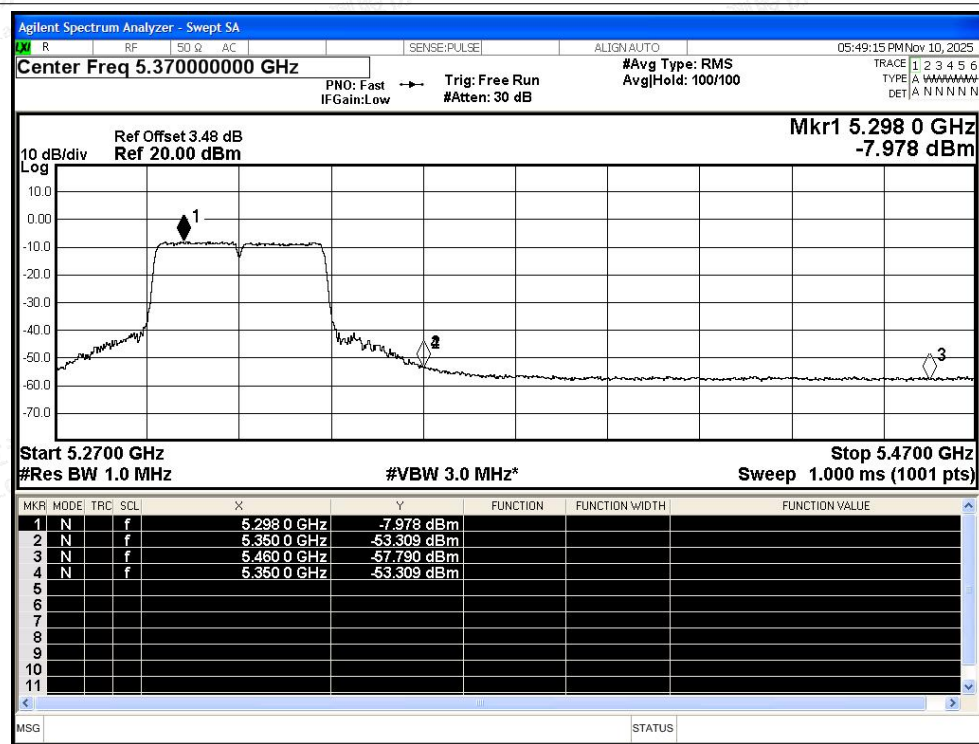

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5290MHz Ant1 Peak

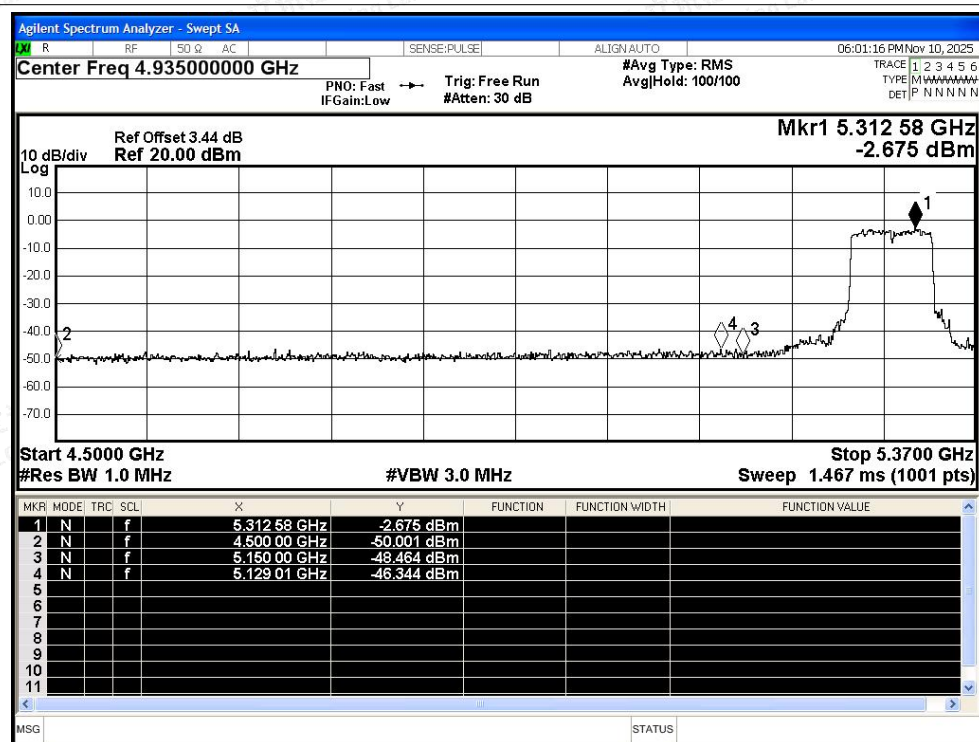

Restrict Band NVNT ac80 5290MHz Ant1 Average

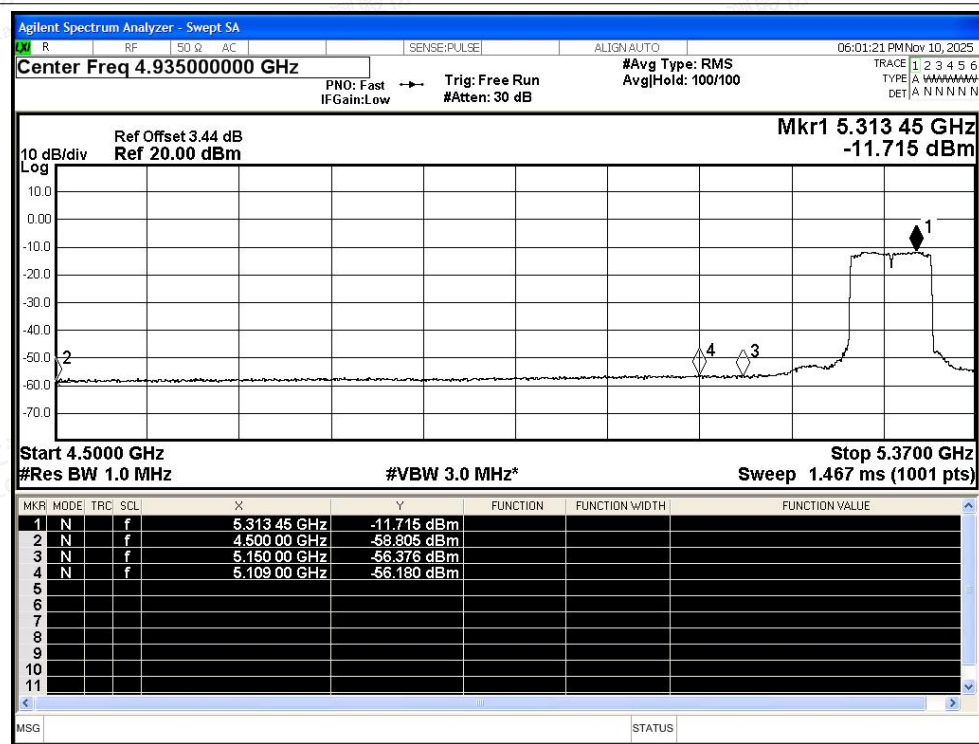

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5290MHz Ant1 Peak

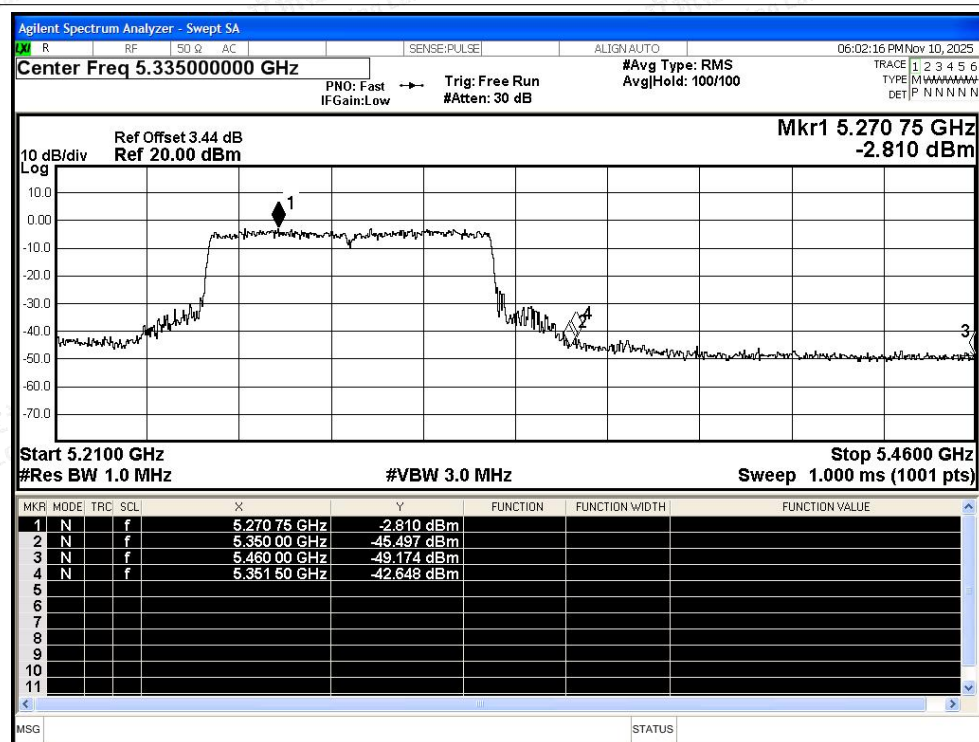

Restrict Band NVNT ac80 5290MHz Ant1 Average

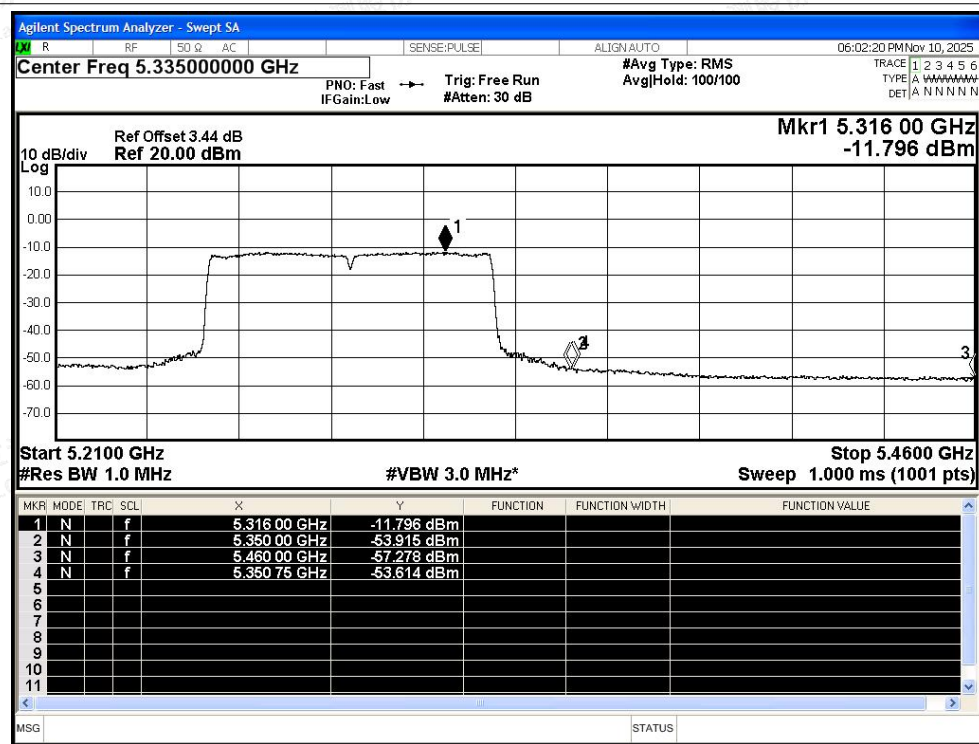

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5260MHz Ant1 Peak

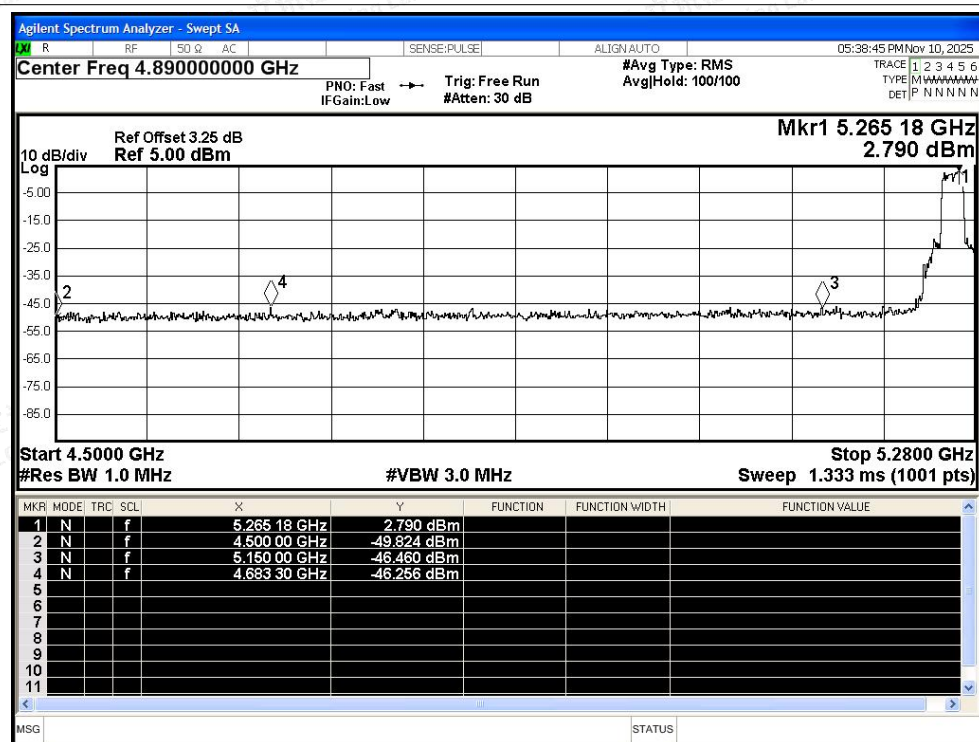

Restrict Band NVNT ax20 5260MHz Ant1 Average

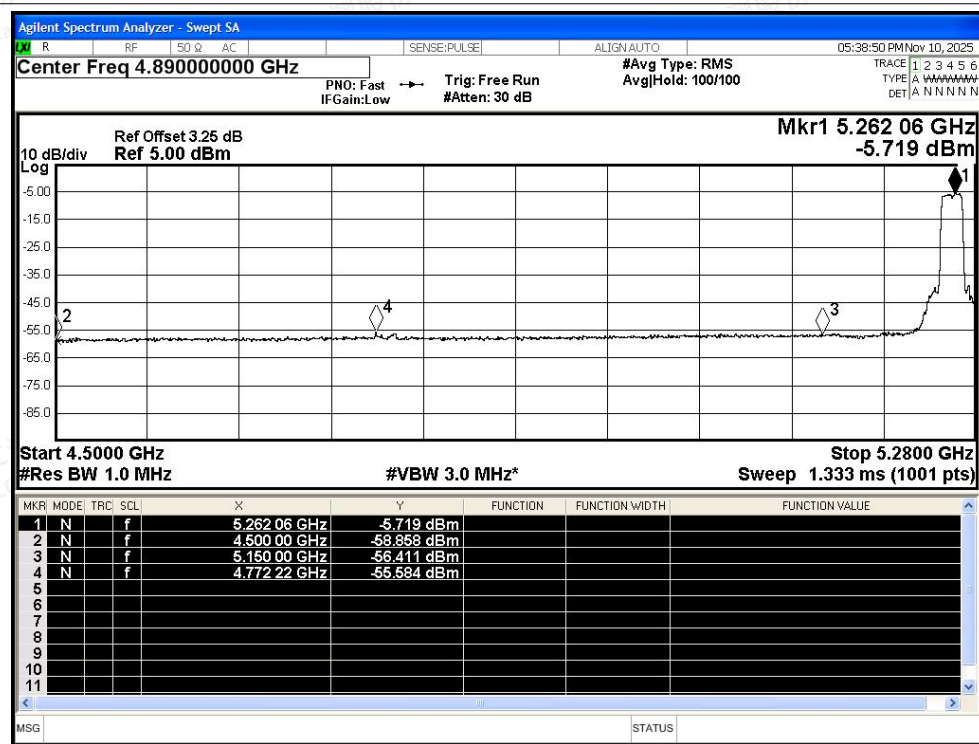

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5320MHz Ant1 Peak

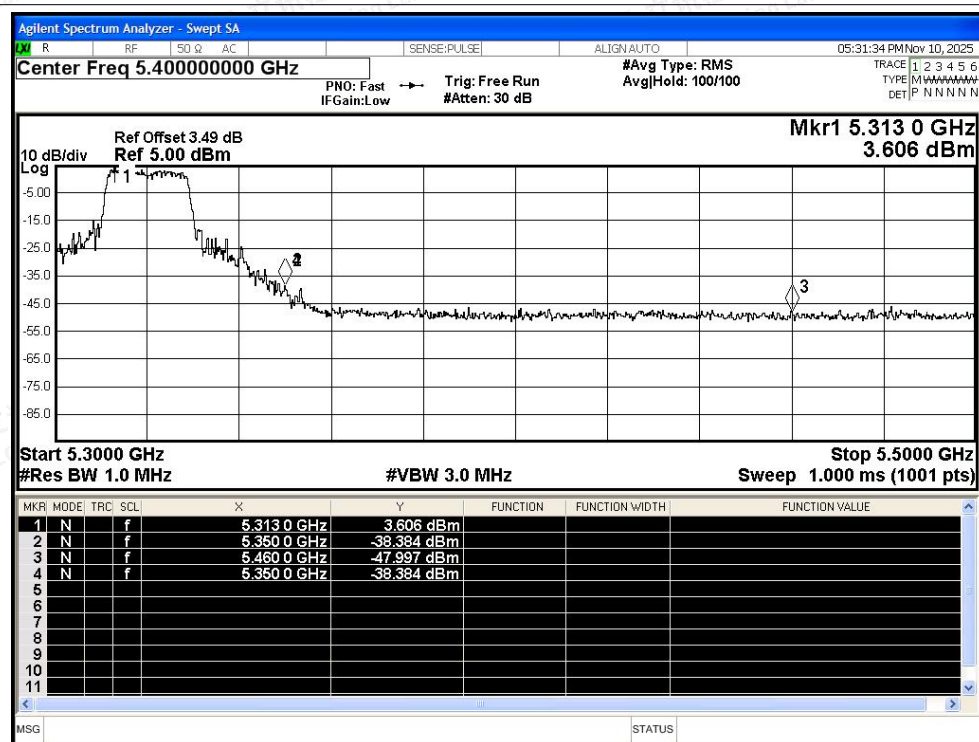

Restrict Band NVNT ax20 5320MHz Ant1 Average

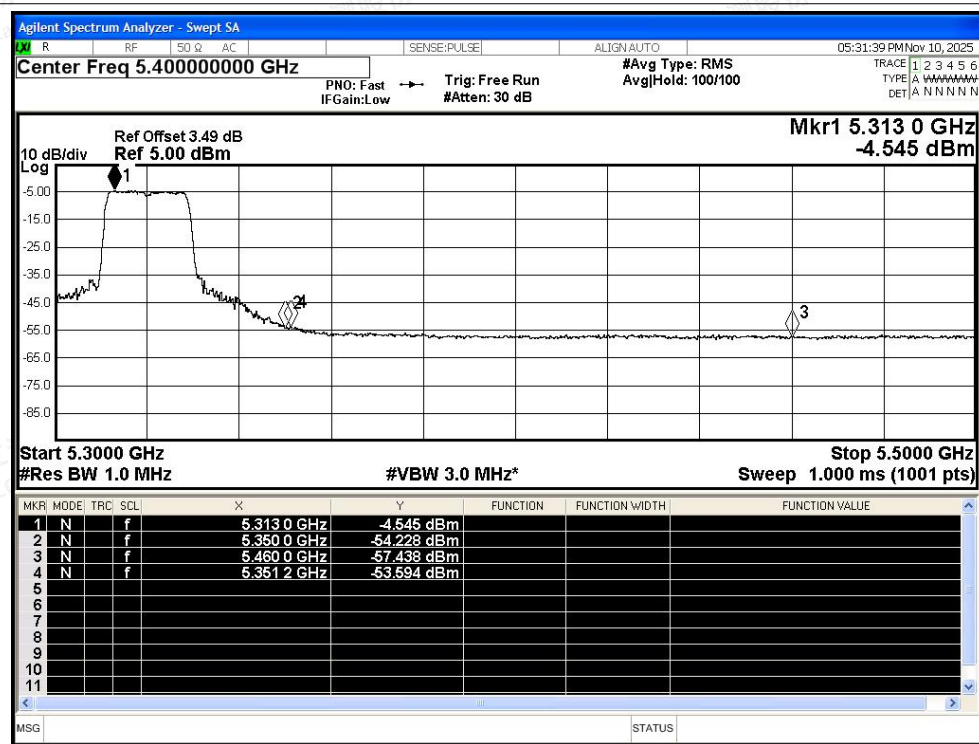

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5270MHz Ant1 Peak

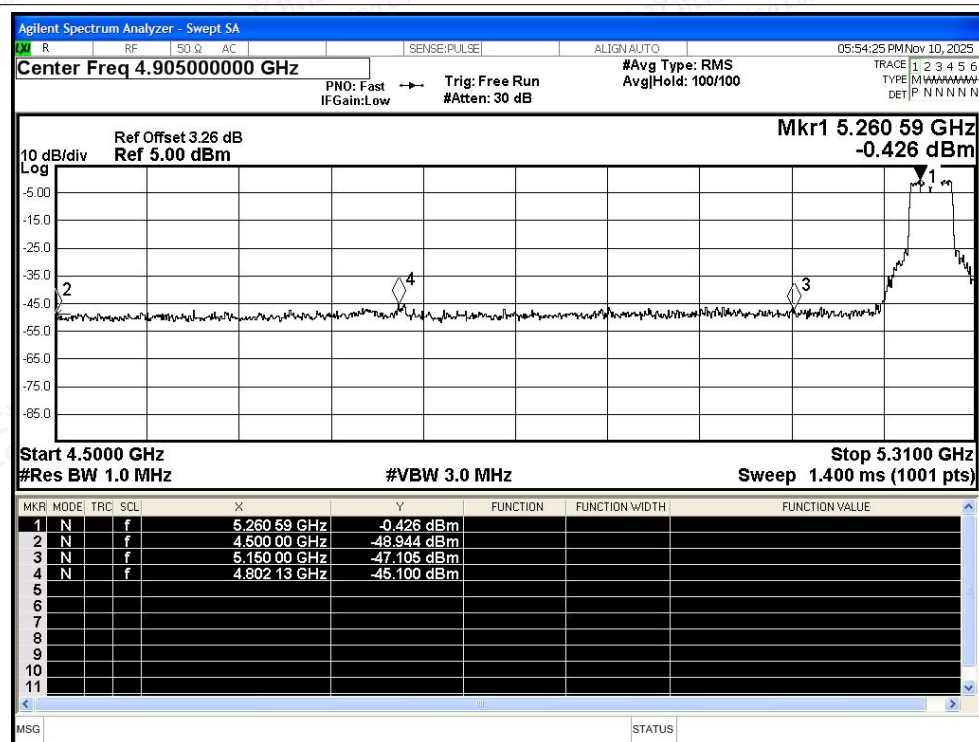

Restrict Band NVNT ax40 5270MHz Ant1 Average

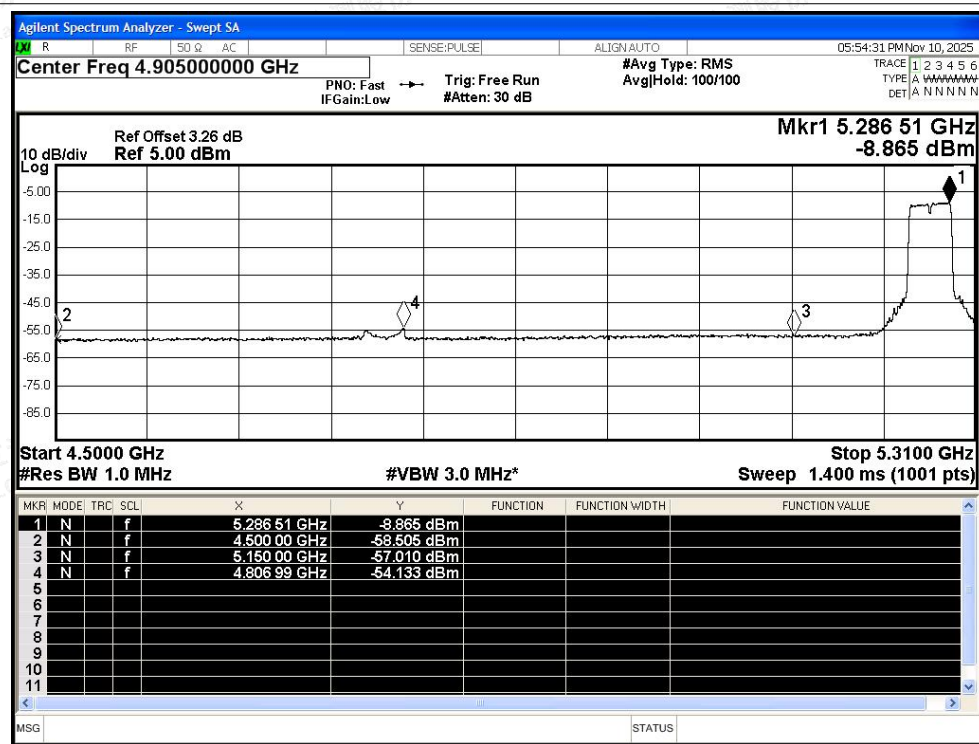

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5310MHz Ant1 Peak

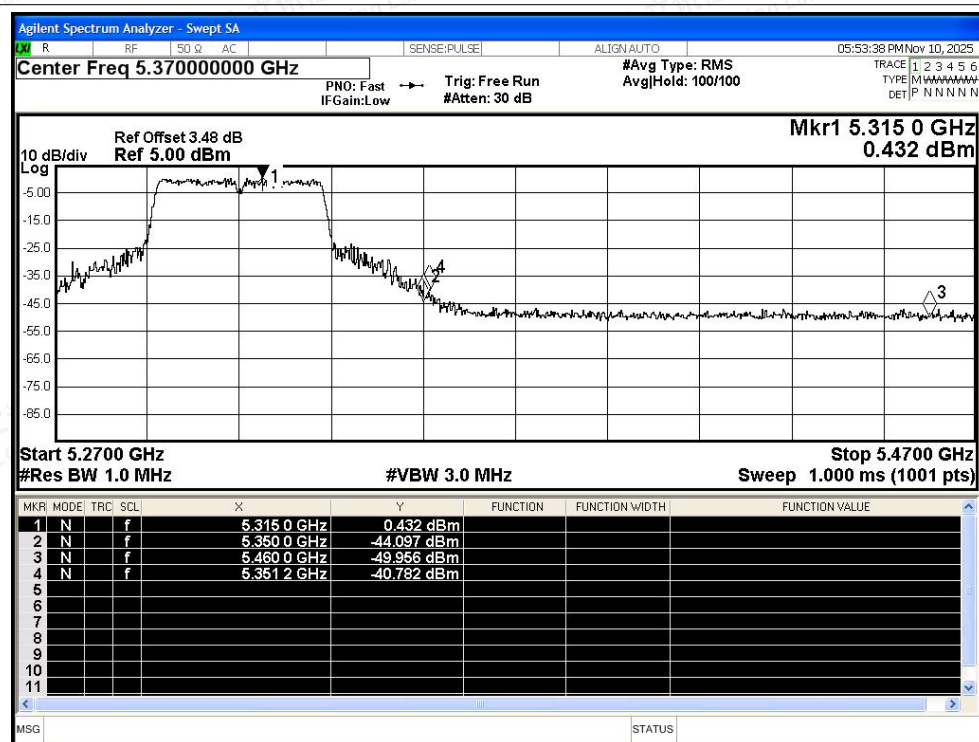

Restrict Band NVNT ax40 5310MHz Ant1 Average

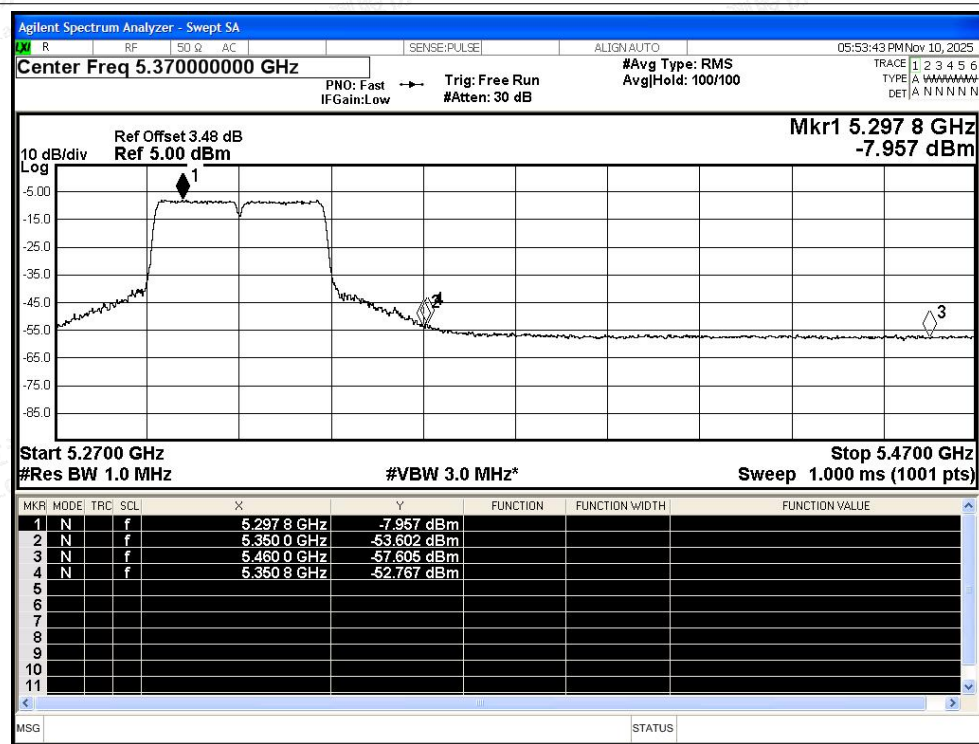

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5290MHz Ant1 Peak

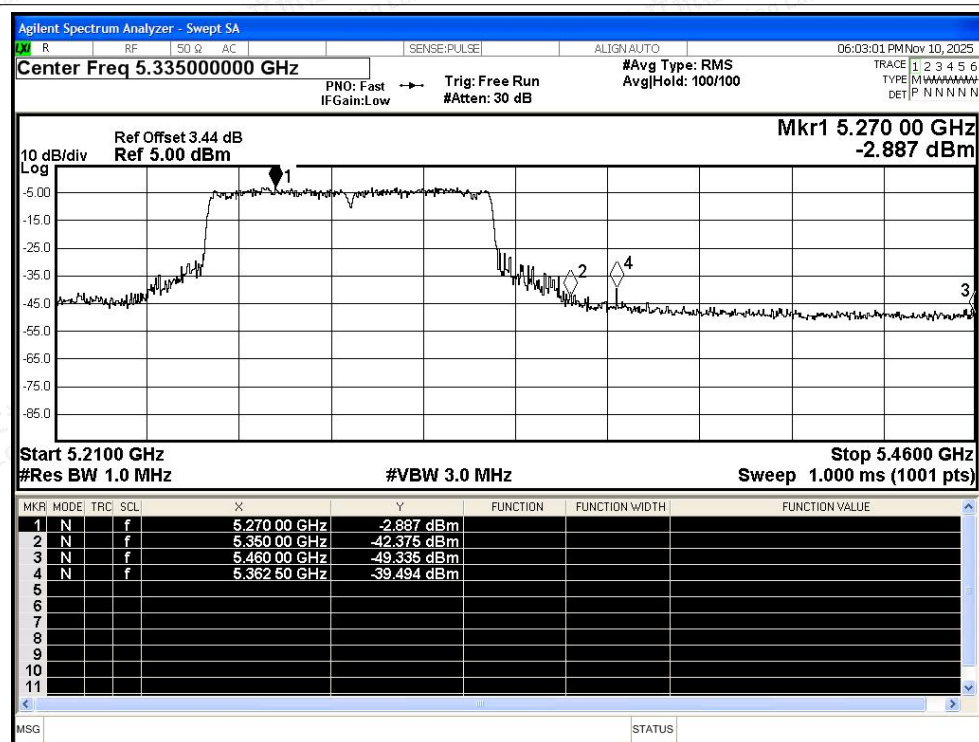

Restrict Band NVNT ax80 5290MHz Ant1 Average

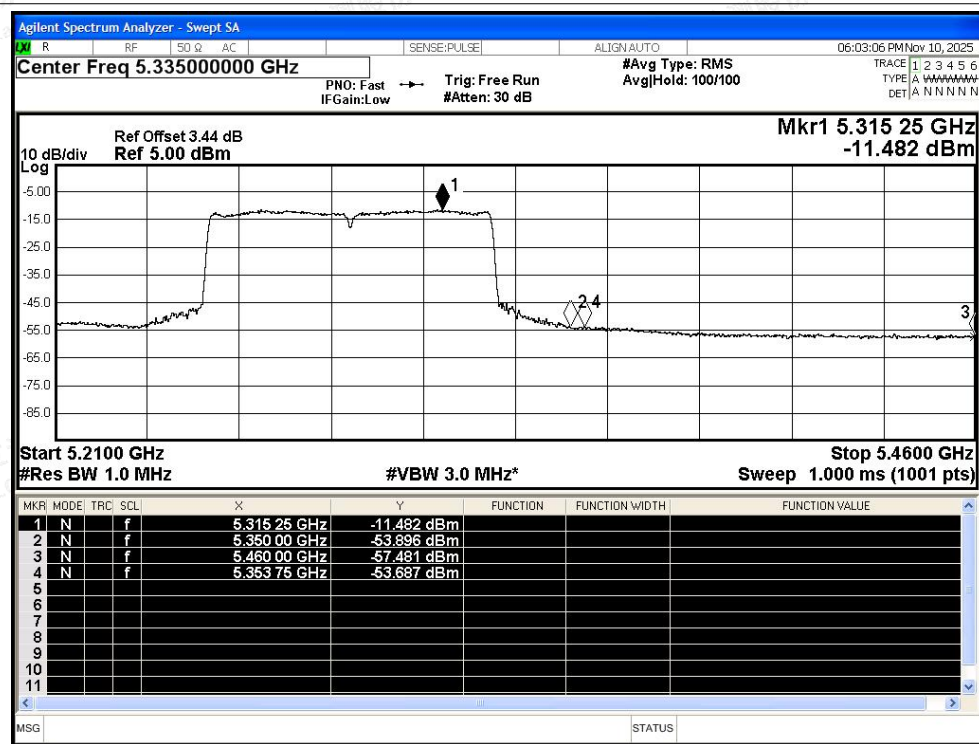

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5290MHz Ant1 Peak

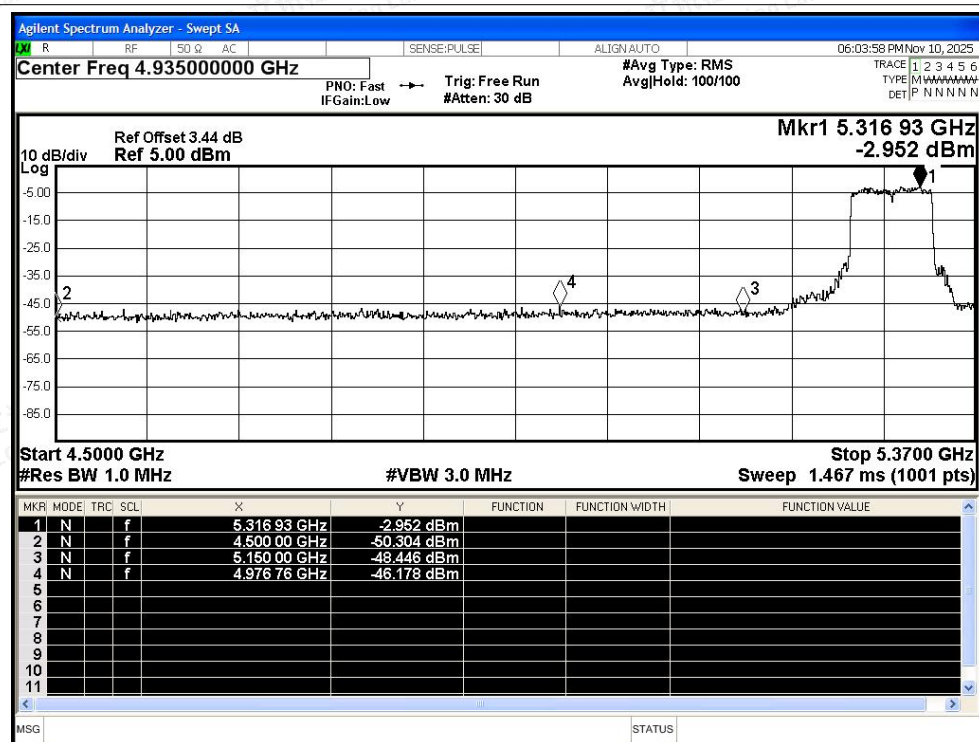

Restrict Band NVNT ax80 5290MHz Ant1 Average

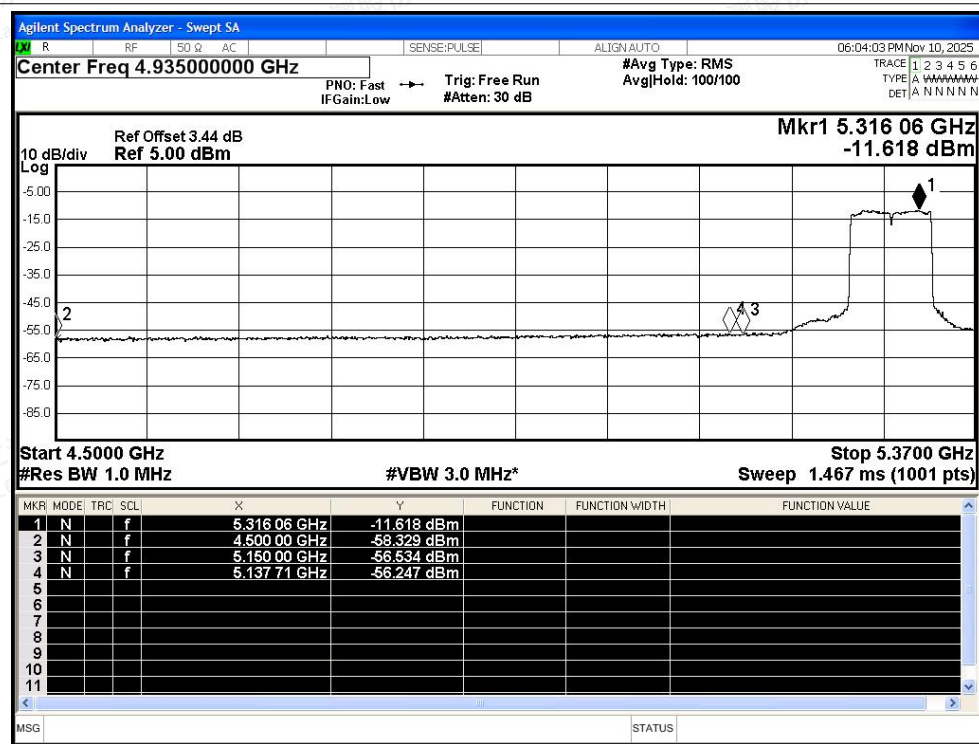

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5260	Ant2	4500	-50.88	5.58	-	49.93	Peak	68.2	Pass
NVNT	a	5260	Ant2	4500	-58.9	5.58	0.1	42.01	Average	54	Pass
NVNT	a	5260	Ant2	5087.34	-44.91	5.58	-	55.90	Peak	68.2	Pass
NVNT	a	5260	Ant2	5149.74	-55.82	5.58	0.1	45.09	Average	54	Pass
NVNT	a	5260	Ant2	5150	-49.21	5.58	-	51.60	Peak	68.2	Pass
NVNT	a	5260	Ant2	5150	-55.82	5.58	0.1	45.09	Average	54	Pass
NVNT	a	5320	Ant2	5350	-43.05	5.58	-	57.76	Peak	68.2	Pass
NVNT	a	5320	Ant2	5350	-54.63	5.58	0.1	46.28	Average	54	Pass
NVNT	a	5320	Ant2	5351.2	-41.65	5.58	-	59.16	Peak	68.2	Pass
NVNT	a	5320	Ant2	5351.6	-54.1	5.58	0.1	46.81	Average	54	Pass
NVNT	a	5320	Ant2	5460	-49.63	5.58	-	51.18	Peak	68.2	Pass
NVNT	a	5320	Ant2	5460	-57.62	5.58	0.1	43.29	Average	54	Pass
NVNT	n20	5260	Ant2	4500	-51.11	5.58	-	49.70	Peak	68.2	Pass
NVNT	n20	5260	Ant2	4500	-59.27	5.58	0.12	41.66	Average	54	Pass
NVNT	n20	5260	Ant2	5105.28	-46.03	5.58	-	54.78	Peak	68.2	Pass
NVNT	n20	5260	Ant2	4787.82	-56.05	5.58	0.12	44.88	Average	54	Pass
NVNT	n20	5260	Ant2	5150	-49.22	5.58	-	51.59	Peak	68.2	Pass
NVNT	n20	5260	Ant2	5150	-56.59	5.58	0.12	44.34	Average	54	Pass
NVNT	n20	5320	Ant2	5350	-41.62	5.58	-	59.19	Peak	68.2	Pass
NVNT	n20	5320	Ant2	5350	-53.26	5.58	0.12	47.67	Average	54	Pass
NVNT	n20	5320	Ant2	5350	-41.62	5.58	-	59.19	Peak	68.2	Pass
NVNT	n20	5320	Ant2	5350.6	-52.82	5.58	0.12	48.11	Average	54	Pass
NVNT	n20	5320	Ant2	5460	-49.15	5.58	-	51.66	Peak	68.2	Pass
NVNT	n20	5320	Ant2	5460	-57.29	5.58	0.12	43.64	Average	54	Pass
NVNT	n40	5270	Ant2	4500	-49.61	5.58	-	51.20	Peak	68.2	Pass
NVNT	n40	5270	Ant2	4500	-58.87	5.58	0.24	42.18	Average	54	Pass
NVNT	n40	5270	Ant2	5143.14	-45.91	5.58	-	54.90	Peak	68.2	Pass
NVNT	n40	5270	Ant2	4806.99	-54.25	5.58	0.24	46.80	Average	54	Pass
NVNT	n40	5270	Ant2	5150	-49.47	5.58	-	51.34	Peak	68.2	Pass
NVNT	n40	5270	Ant2	5150	-57.39	5.58	0.24	43.66	Average	54	Pass
NVNT	n40	5310	Ant2	5350	-42.43	5.58	-	58.38	Peak	68.2	Pass
NVNT	n40	5310	Ant2	5350	-54	5.58	0.24	47.05	Average	54	Pass
NVNT	n40	5310	Ant2	5350.4	-39.98	5.58	-	60.83	Peak	68.2	Pass
NVNT	n40	5310	Ant2	5350.6	-53.76	5.58	0.24	47.29	Average	54	Pass
NVNT	n40	5310	Ant2	5460	-48.4	5.58	-	52.41	Peak	68.2	Pass
NVNT	n40	5310	Ant2	5460	-57.52	5.58	0.24	43.53	Average	54	Pass
NVNT	ac20	5260	Ant2	4500	-49.56	5.58	-	51.25	Peak	68.2	Pass
NVNT	ac20	5260	Ant2	4500	-58.26	5.58	0.12	42.67	Average	54	Pass
NVNT	ac20	5260	Ant2	5082.66	-45.96	5.58	-	54.85	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5260	Ant2	4787.04	-56.14	5.58	0.12	44.79	Average	54	Pass
NVNT	ac20	5260	Ant2	5150	-48.71	5.58	-	52.10	Peak	68.2	Pass
NVNT	ac20	5260	Ant2	5150	-57.13	5.58	0.12	43.80	Average	54	Pass
NVNT	ac20	5320	Ant2	5350	-37.33	5.58	-	63.48	Peak	68.2	Pass
NVNT	ac20	5320	Ant2	5350	-54.62	5.58	0.12	46.31	Average	54	Pass
NVNT	ac20	5320	Ant2	5350	-37.33	5.58	-	63.48	Peak	68.2	Pass
NVNT	ac20	5320	Ant2	5350.6	-52.23	5.58	0.12	48.70	Average	54	Pass
NVNT	ac20	5320	Ant2	5460	-50.45	5.58	-	50.36	Peak	68.2	Pass
NVNT	ac20	5320	Ant2	5460	-57.73	5.58	0.12	43.20	Average	54	Pass
NVNT	ac40	5270	Ant2	4500	-50.97	5.58	-	49.84	Peak	68.2	Pass
NVNT	ac40	5270	Ant2	4500	-58.39	5.58	0.23	42.65	Average	54	Pass
NVNT	ac40	5270	Ant2	4806.99	-45.55	5.58	-	55.26	Peak	68.2	Pass
NVNT	ac40	5270	Ant2	4806.99	-53.86	5.58	0.23	47.18	Average	54	Pass
NVNT	ac40	5270	Ant2	5150	-48.76	5.58	-	52.05	Peak	68.2	Pass
NVNT	ac40	5270	Ant2	5150	-56.63	5.58	0.23	44.41	Average	54	Pass
NVNT	ac40	5310	Ant2	5350	-37.46	5.58	-	63.35	Peak	68.2	Pass
NVNT	ac40	5310	Ant2	5350	-53.21	5.58	0.24	47.84	Average	54	Pass
NVNT	ac40	5310	Ant2	5350.2	-36.91	5.58	-	63.90	Peak	68.2	Pass
NVNT	ac40	5310	Ant2	5350	-53.21	5.58	0.24	47.84	Average	54	Pass
NVNT	ac40	5310	Ant2	5460	-49.71	5.58	-	51.10	Peak	68.2	Pass
NVNT	ac40	5310	Ant2	5460	-57.87	5.58	0.24	43.18	Average	54	Pass
NVNT	ac80	5290	Ant2	4500	-50.43	5.58	-	50.38	Peak	68.2	Pass
NVNT	ac80	5290	Ant2	4500	-58.6	5.58	0.47	42.68	Average	54	Pass
NVNT	ac80	5290	Ant2	5149.89	-46.59	5.58	-	54.22	Peak	68.2	Pass
NVNT	ac80	5290	Ant2	5142.93	-56.25	5.58	0.47	45.03	Average	54	Pass
NVNT	ac80	5290	Ant2	5150	-46.59	5.58	-	54.22	Peak	68.2	Pass
NVNT	ac80	5290	Ant2	5150	-56.92	5.58	0.47	44.36	Average	54	Pass
NVNT	ac80	5290	Ant2	5350	-44.64	5.58	-	56.17	Peak	68.2	Pass
NVNT	ac80	5290	Ant2	5350	-53.69	5.58	0.47	47.59	Average	54	Pass
NVNT	ac80	5290	Ant2	5360.25	-40.84	5.58	-	59.97	Peak	68.2	Pass
NVNT	ac80	5290	Ant2	5350.25	-53.55	5.58	0.47	47.73	Average	54	Pass
NVNT	ac80	5290	Ant2	5460	-49.58	5.58	-	51.23	Peak	68.2	Pass
NVNT	ac80	5290	Ant2	5460	-57.6	5.58	0.47	43.68	Average	54	Pass
NVNT	ax20	5260	Ant2	4500	-50.94	5.58	-	49.87	Peak	68.2	Pass
NVNT	ax20	5260	Ant2	4500	-58.98	5.58	0.12	41.95	Average	54	Pass
NVNT	ax20	5260	Ant2	4786.26	-45.79	5.58	-	55.02	Peak	68.2	Pass
NVNT	ax20	5260	Ant2	4787.04	-56	5.58	0.12	44.93	Average	54	Pass
NVNT	ax20	5260	Ant2	5150	-49.29	5.58	-	51.52	Peak	68.2	Pass
NVNT	ax20	5260	Ant2	5150	-56.92	5.58	0.12	44.01	Average	54	Pass
NVNT	ax20	5320	Ant2	5350	-42.92	5.58	-	57.89	Peak	68.2	Pass
NVNT	ax20	5320	Ant2	5350	-54.82	5.58	0.12	46.11	Average	54	Pass
NVNT	ax20	5320	Ant2	5354.2	-40.53	5.58	-	60.28	Peak	68.2	Pass
NVNT	ax20	5320	Ant2	5350.6	-53	5.58	0.12	47.93	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax20	5320	Ant2	5460	-49.86	5.58	-	50.95	Peak	68.2	Pass
NVNT	ax20	5320	Ant2	5460	-57.8	5.58	0.12	43.13	Average	54	Pass
NVNT	ax40	5270	Ant2	4500	-50.19	5.58	-	50.62	Peak	68.2	Pass
NVNT	ax40	5270	Ant2	4500	-59.1	5.58	0.23	41.94	Average	54	Pass
NVNT	ax40	5270	Ant2	4772.16	-45.53	5.58	-	55.28	Peak	68.2	Pass
NVNT	ax40	5270	Ant2	4806.18	-54.18	5.58	0.23	46.86	Average	54	Pass
NVNT	ax40	5270	Ant2	5150	-49.81	5.58	-	51.00	Peak	68.2	Pass
NVNT	ax40	5270	Ant2	5150	-56.79	5.58	0.23	44.25	Average	54	Pass
NVNT	ax40	5310	Ant2	5350	-42.44	5.58	-	58.37	Peak	68.2	Pass
NVNT	ax40	5310	Ant2	5350	-53.58	5.58	0.24	47.47	Average	54	Pass
NVNT	ax40	5310	Ant2	5351	-40.19	5.58	-	60.62	Peak	68.2	Pass
NVNT	ax40	5310	Ant2	5350	-53.58	5.58	0.24	47.47	Average	54	Pass
NVNT	ax40	5310	Ant2	5460	-49.3	5.58	-	51.51	Peak	68.2	Pass
NVNT	ax40	5310	Ant2	5460	-57.56	5.58	0.24	43.49	Average	54	Pass
NVNT	ax80	5290	Ant2	5350	-42.79	5.58	-	58.02	Peak	68.2	Pass
NVNT	ax80	5290	Ant2	5350	-54.15	5.58	0.47	47.13	Average	54	Pass
NVNT	ax80	5290	Ant2	5352.25	-42.16	5.58	-	58.65	Peak	68.2	Pass
NVNT	ax80	5290	Ant2	5350.5	-53.7	5.58	0.47	47.58	Average	54	Pass
NVNT	ax80	5290	Ant2	5460	-49.27	5.58	-	51.54	Peak	68.2	Pass
NVNT	ax80	5290	Ant2	5460	-57.41	5.58	0.47	43.87	Average	54	Pass
NVNT	ax80	5290	Ant2	4500	-48.55	5.58	-	52.26	Peak	68.2	Pass
NVNT	ax80	5290	Ant2	4500	-58.25	5.58	0.47	43.03	Average	54	Pass
NVNT	ax80	5290	Ant2	5095.95	-45.41	5.58	-	55.40	Peak	68.2	Pass
NVNT	ax80	5290	Ant2	5142.06	-56.11	5.58	0.47	45.17	Average	54	Pass
NVNT	ax80	5290	Ant2	5150	-48.81	5.58	-	52.00	Peak	68.2	Pass
NVNT	ax80	5290	Ant2	5150	-56.57	5.58	0.47	44.71	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Restrict Band NVNT a 5260MHz Ant2 Peak

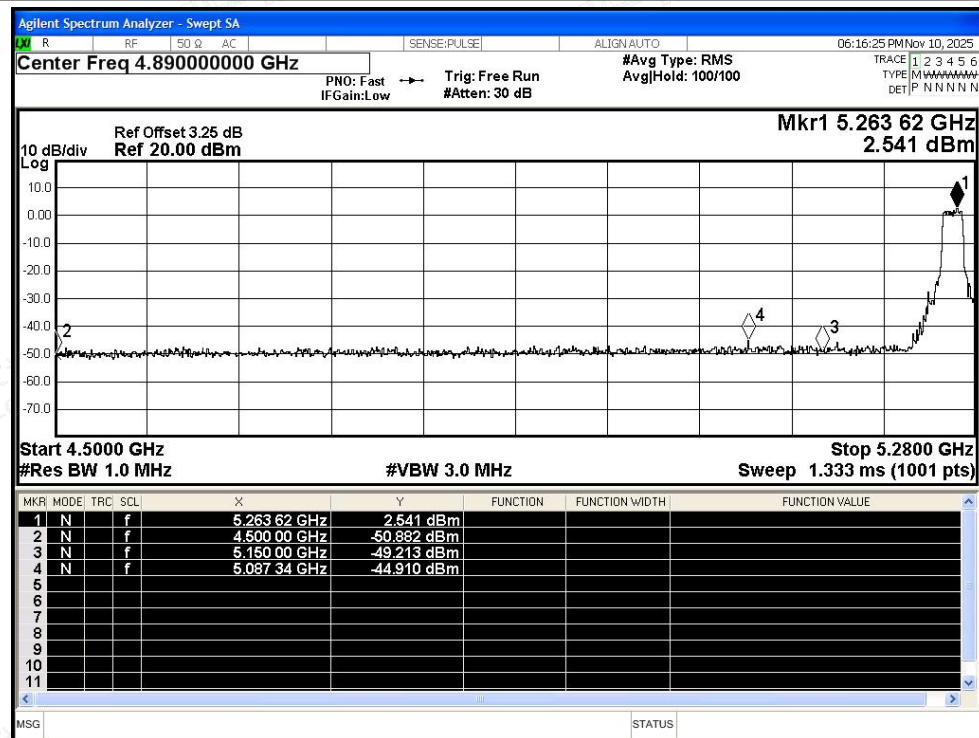

Restrict Band NVNT a 5260MHz Ant2 Average

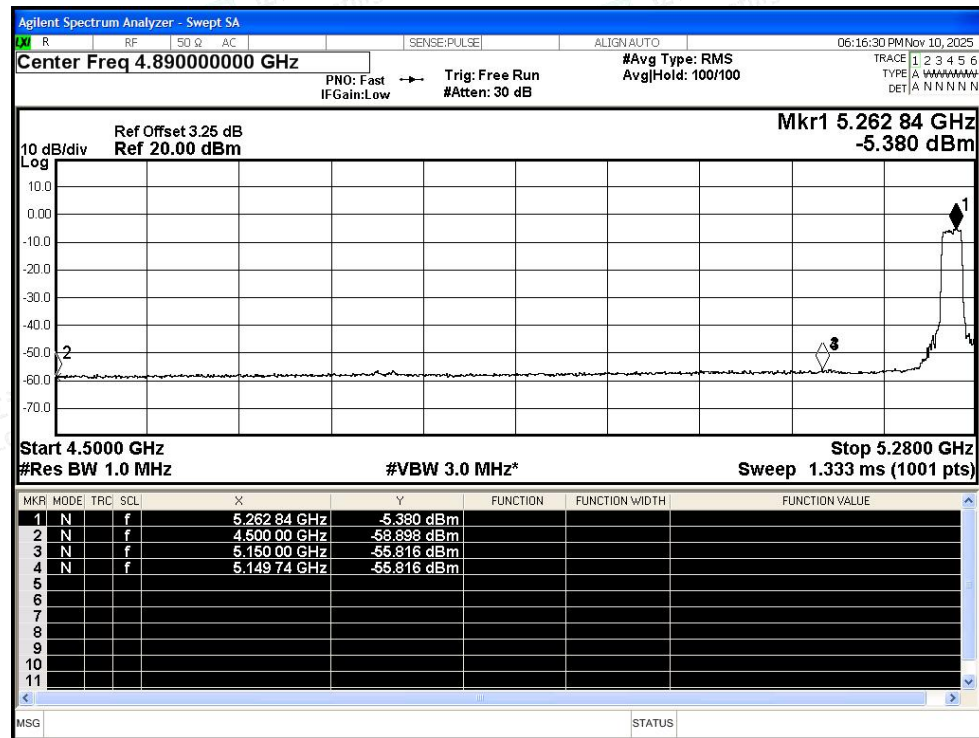

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5320MHz Ant2 Peak

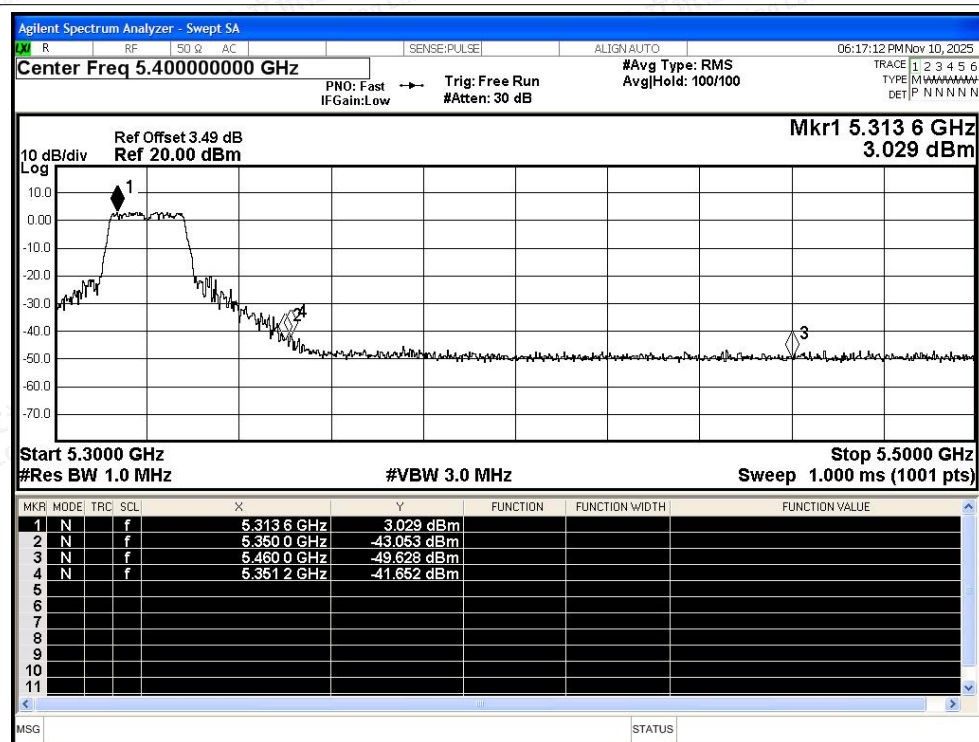

Restrict Band NVNT a 5320MHz Ant2 Average

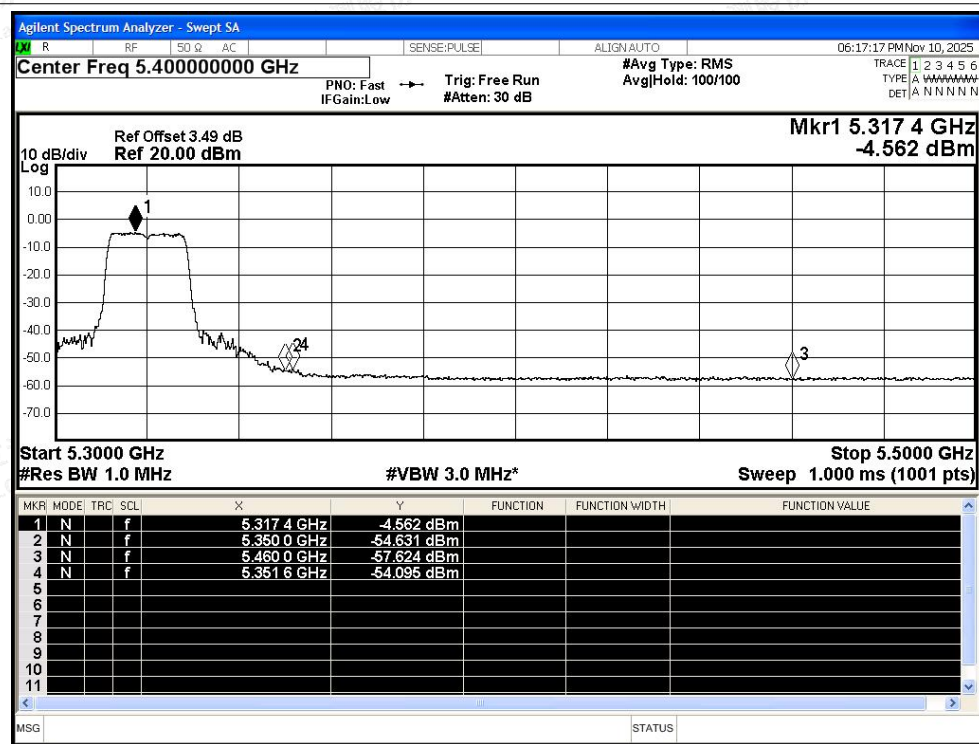

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5260MHz Ant2 Peak

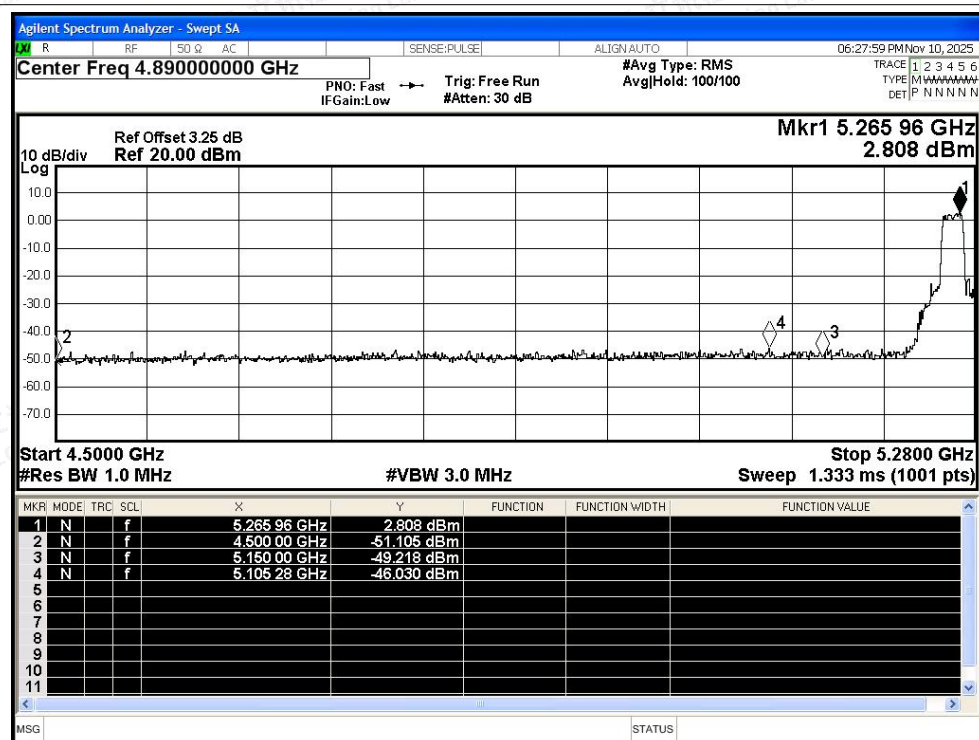

Restrict Band NVNT n20 5260MHz Ant2 Average

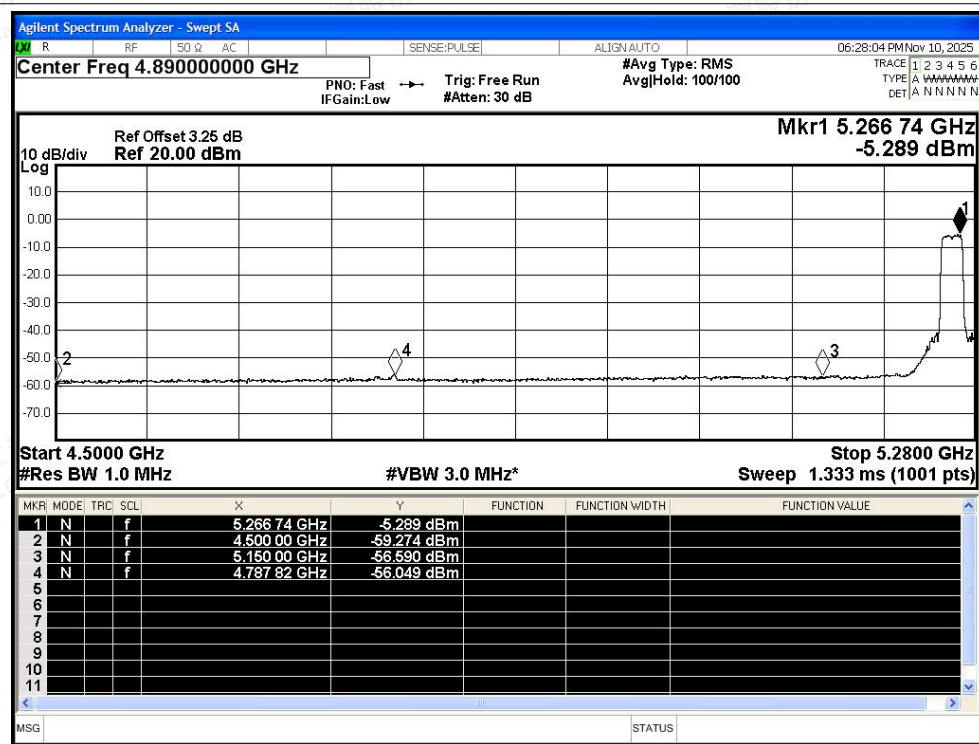

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5320MHz Ant2 Peak

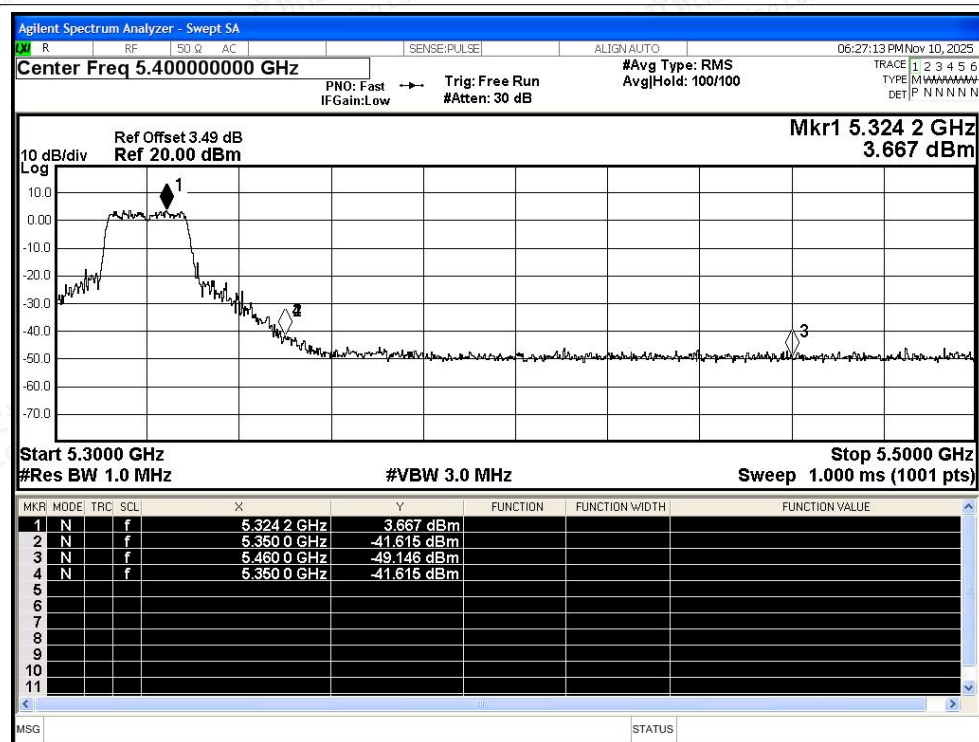

Restrict Band NVNT n20 5320MHz Ant2 Average

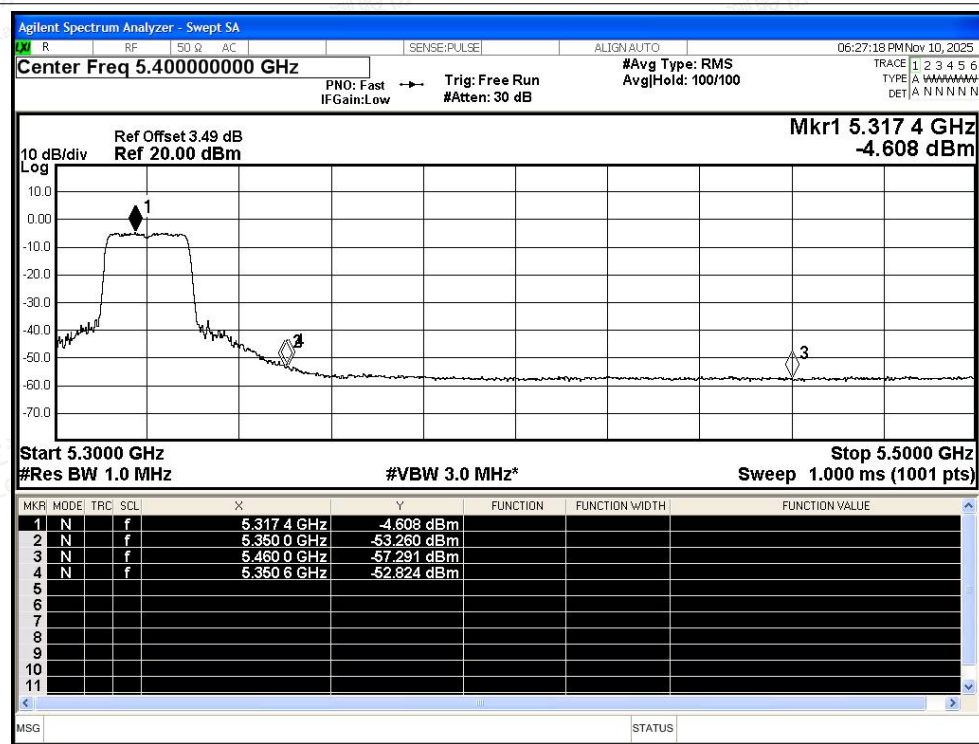

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5270MHz Ant2 Peak

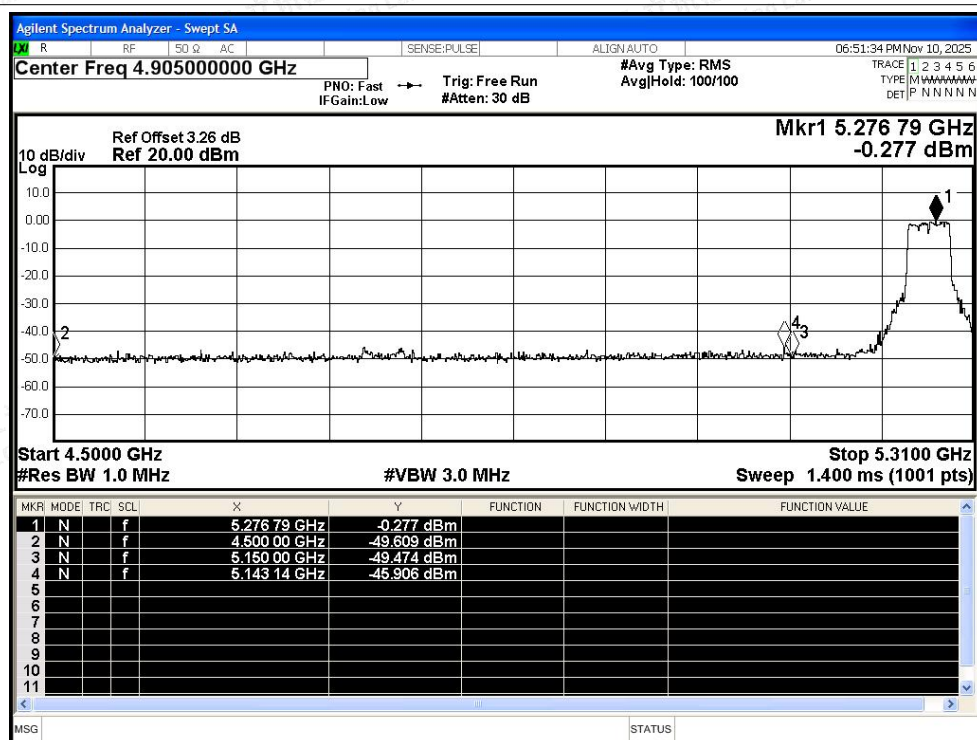

Restrict Band NVNT n40 5270MHz Ant2 Average

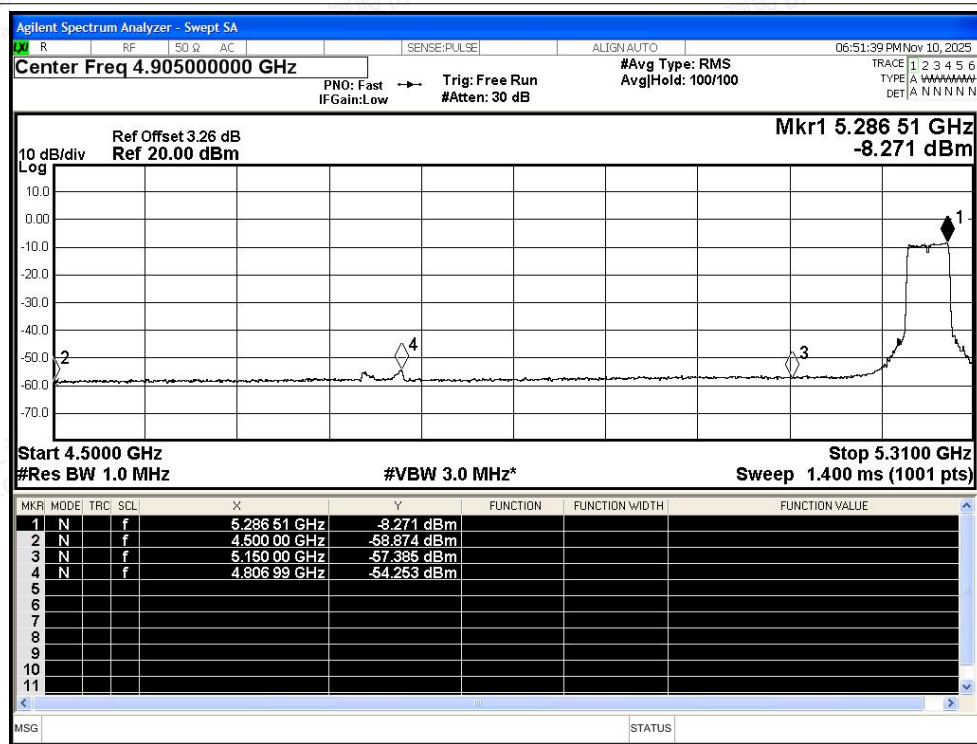

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity