
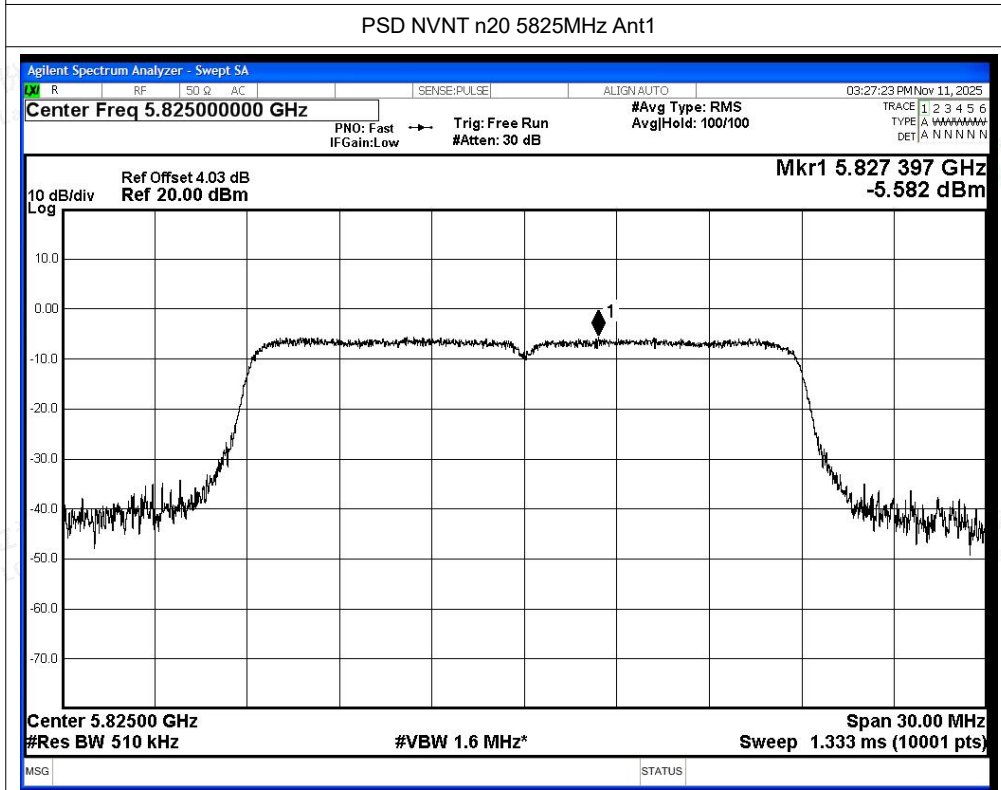



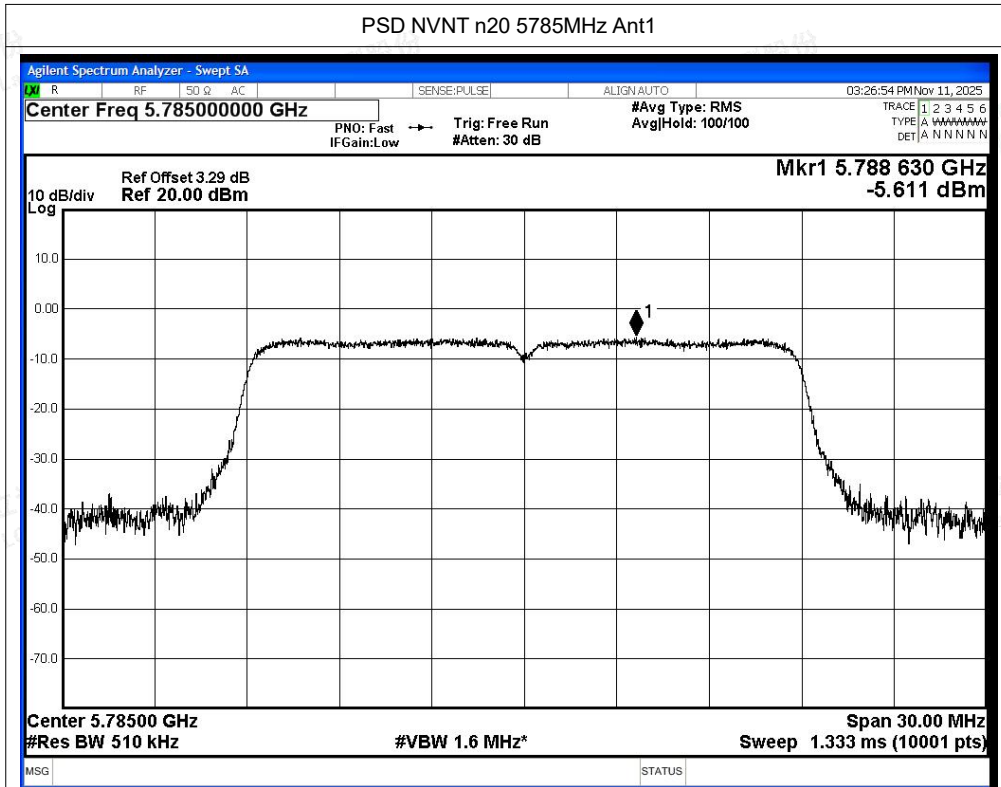


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

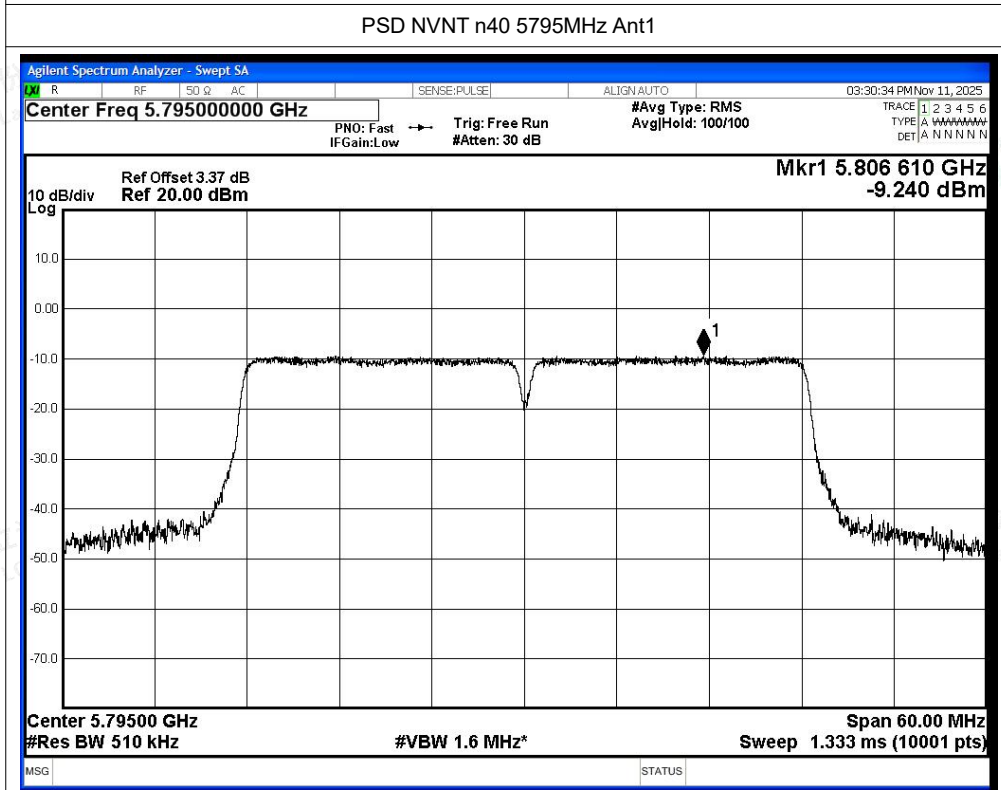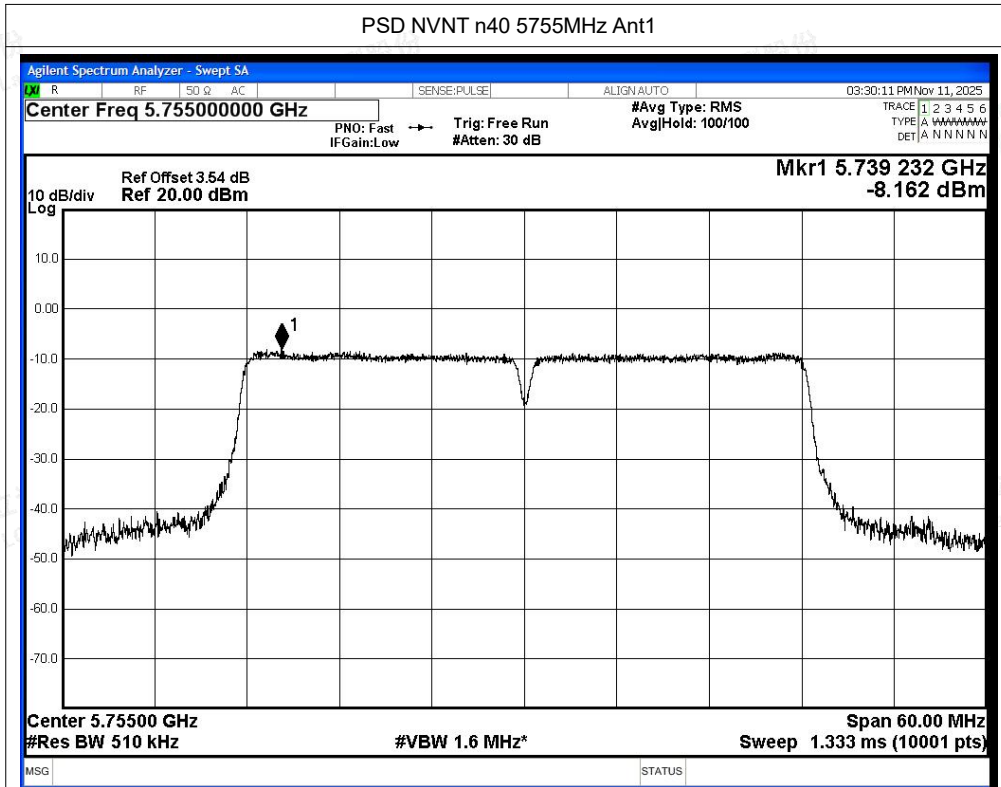

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ac20 5745MHz Ant1

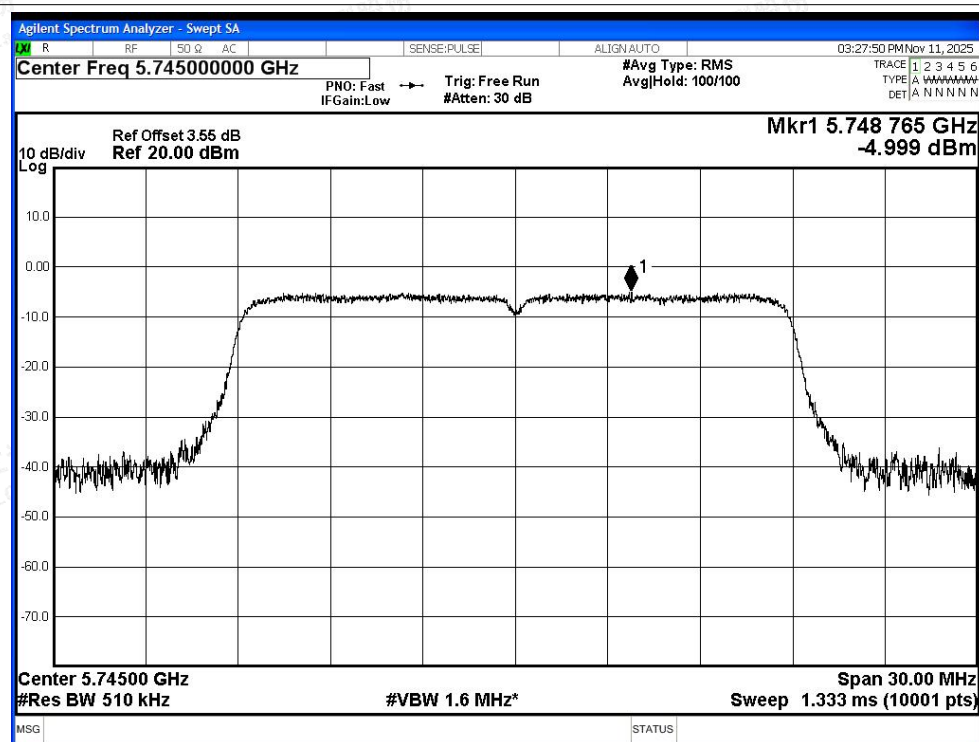

PSD NVNT ac20 5785MHz Ant1

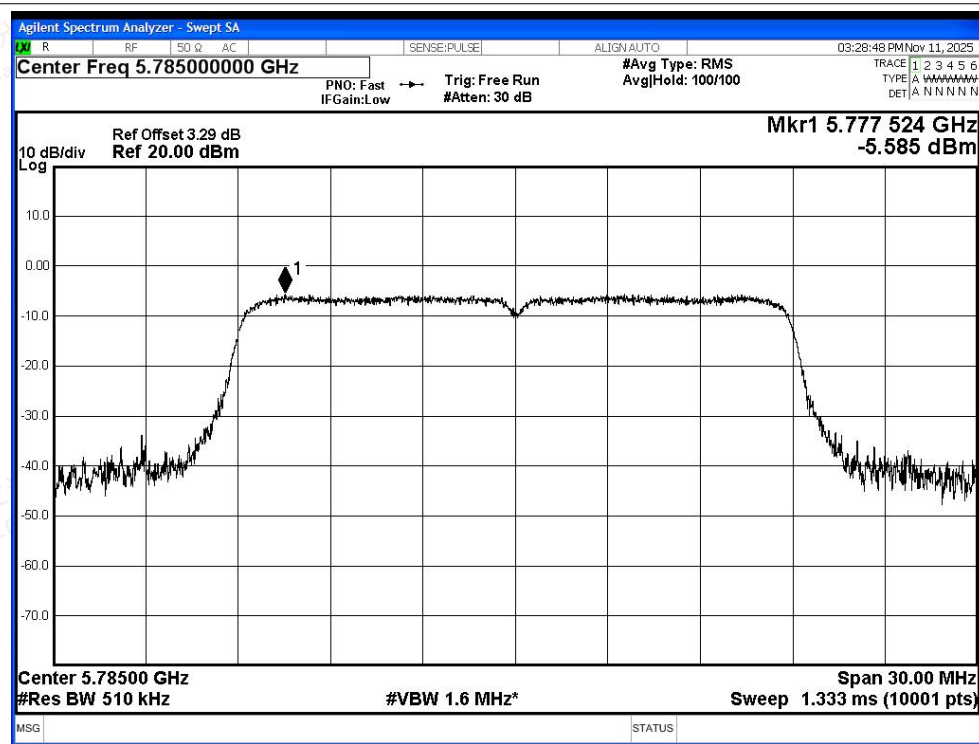

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ac20 5825MHz Ant1

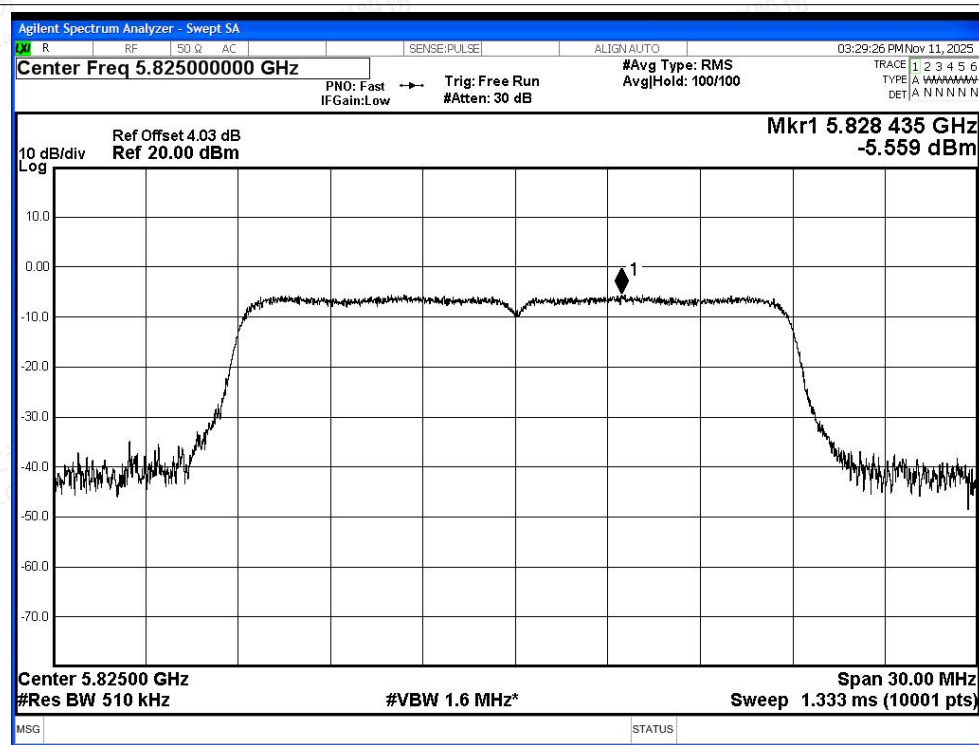

PSD NVNT ac40 5755MHz Ant1

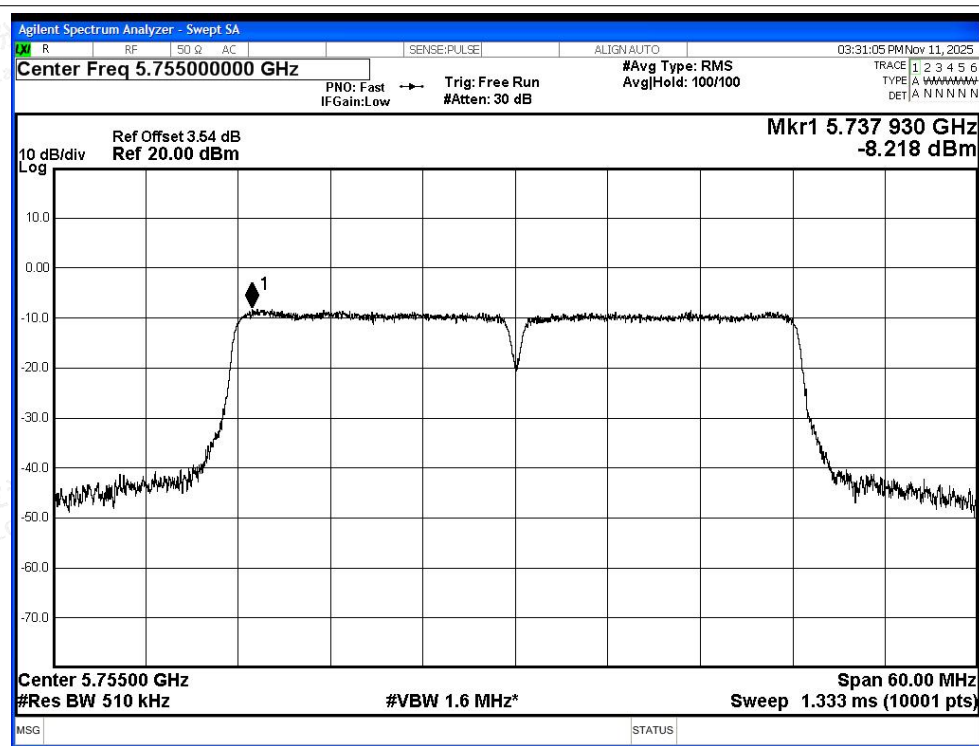

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ac40 5795MHz Ant1

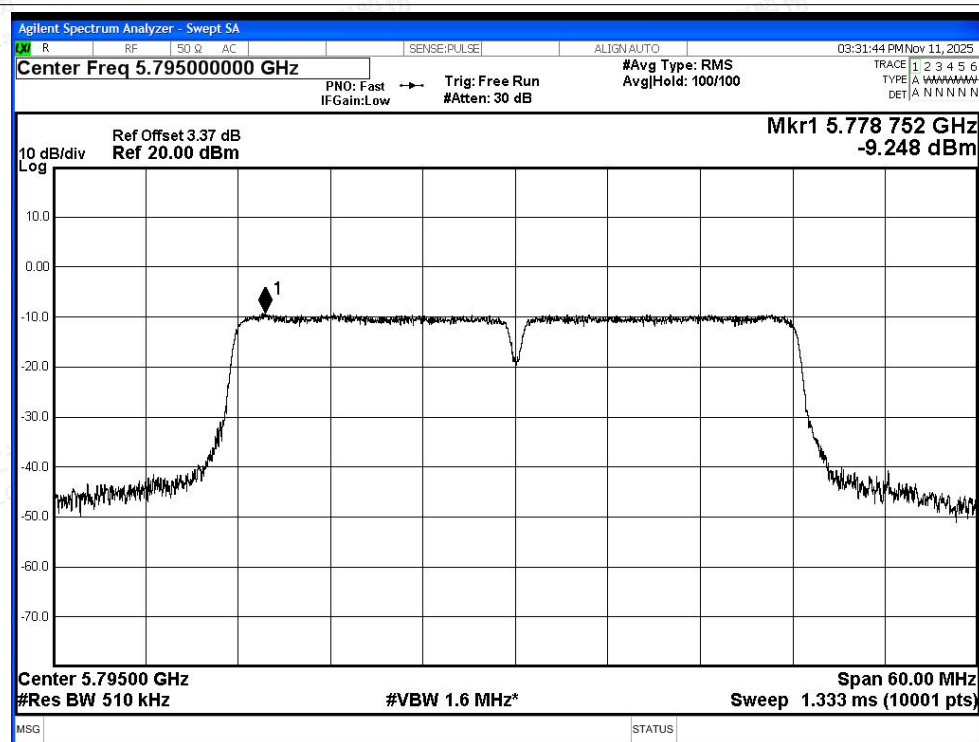

PSD NVNT ac80 5775MHz Ant1

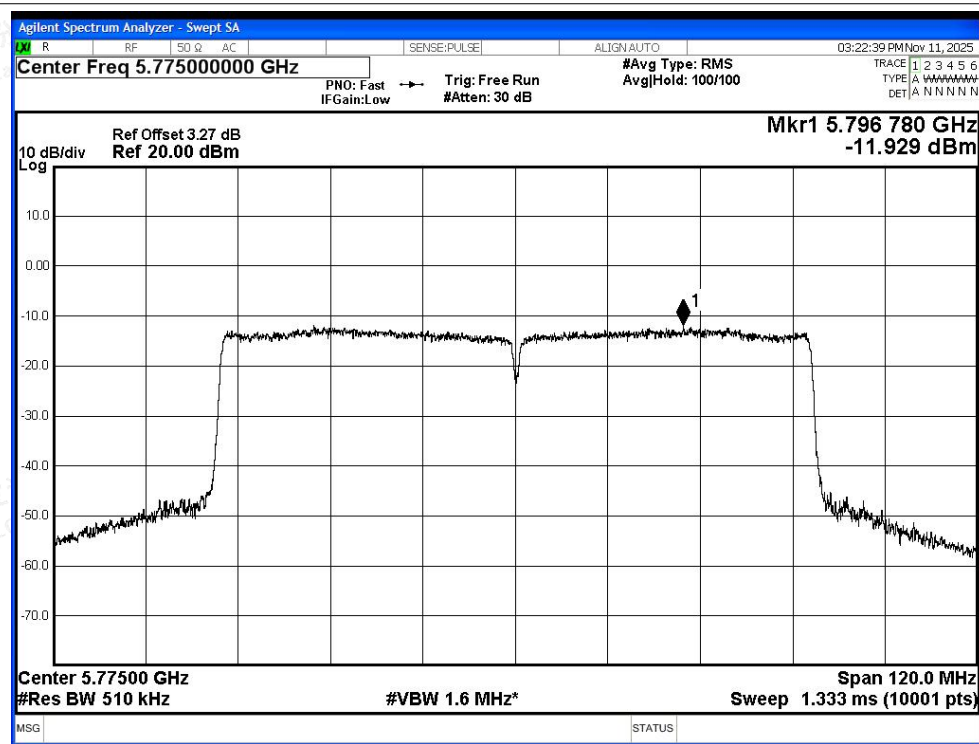

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ax20 5745MHz Ant1

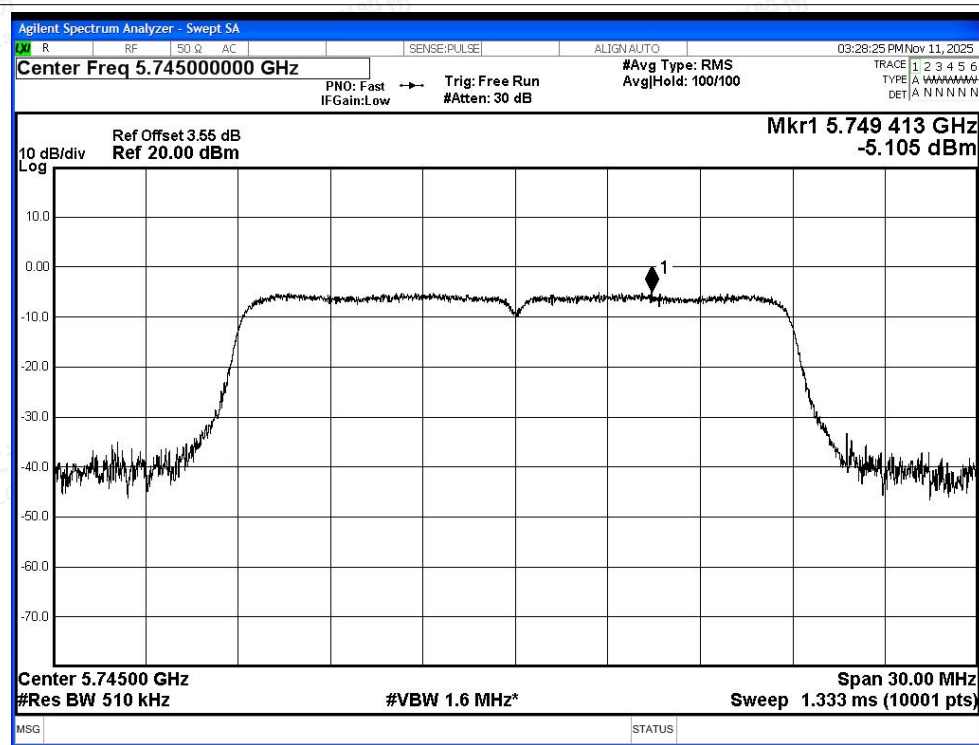

PSD NVNT ax20 5785MHz Ant1

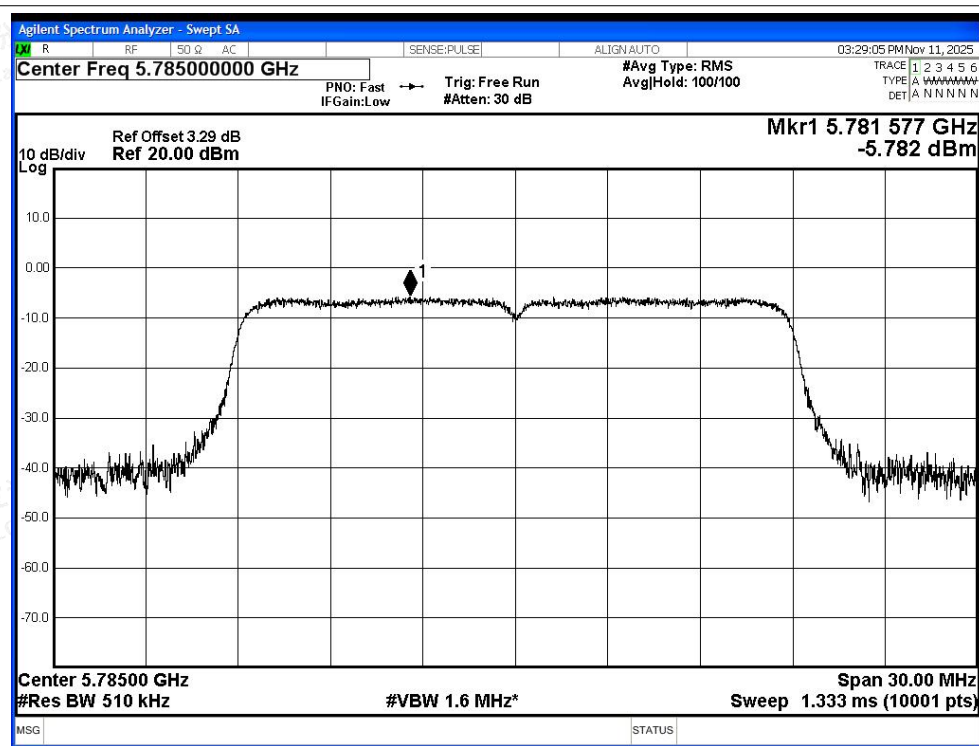

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ax20 5825MHz Ant1

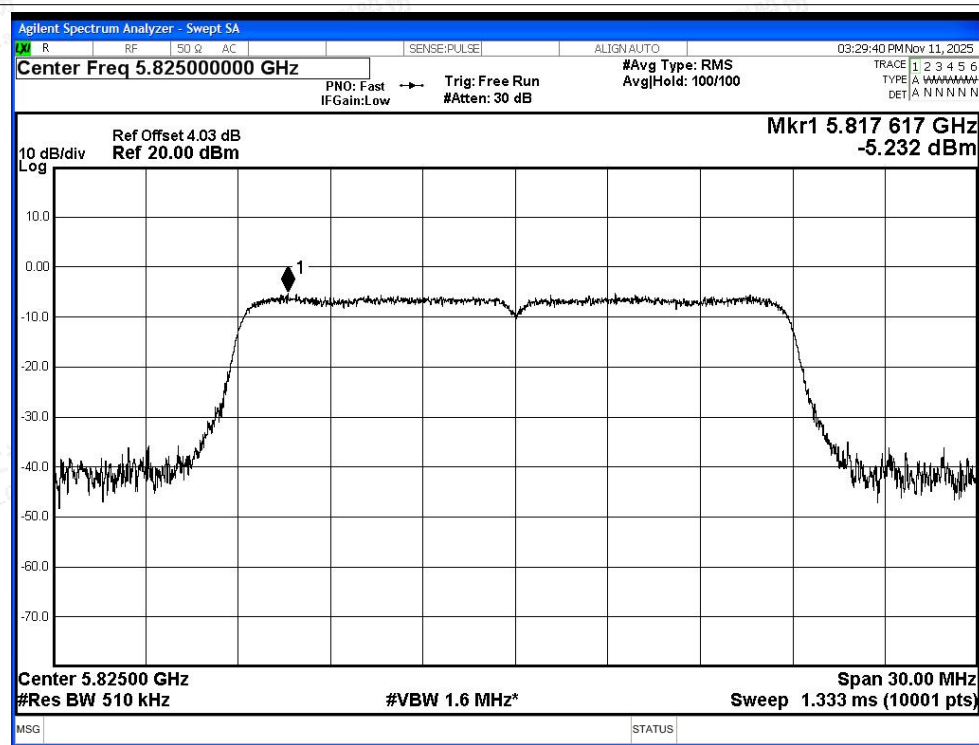

PSD NVNT ax40 5755MHz Ant1

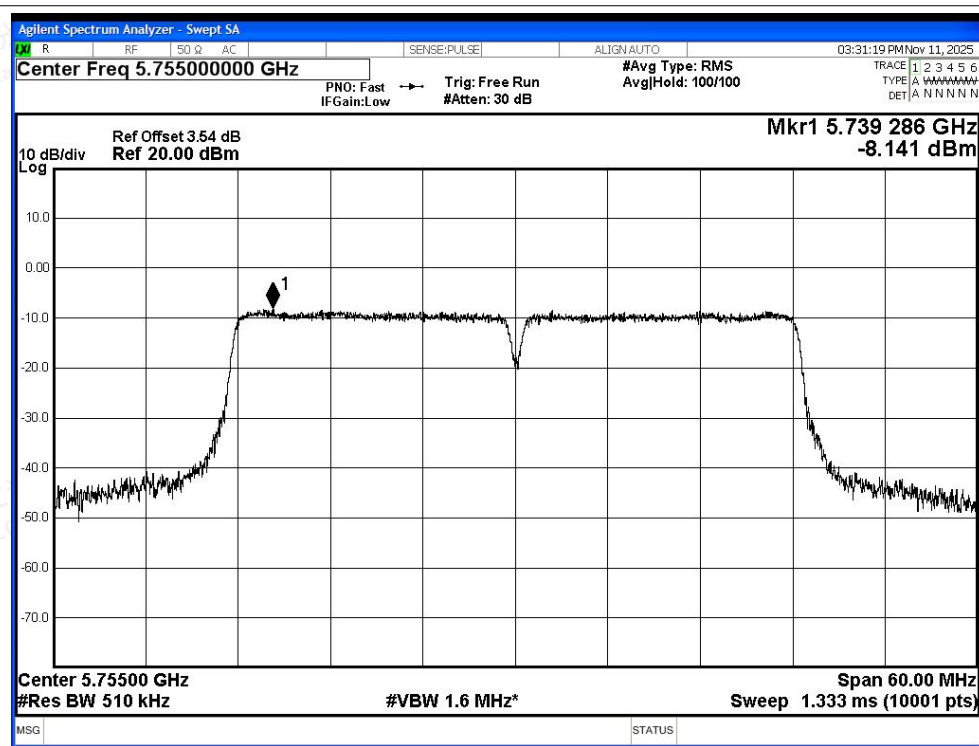

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



PSD NVNT ax40 5795MHz Ant1

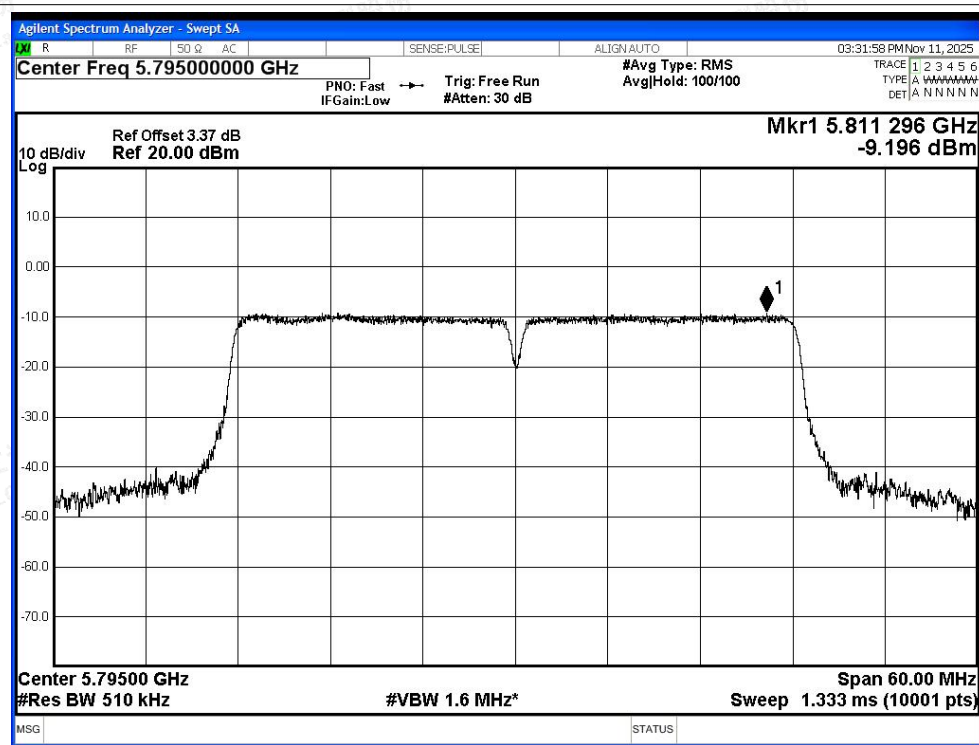

PSD NVNT ax80 5775MHz Ant1


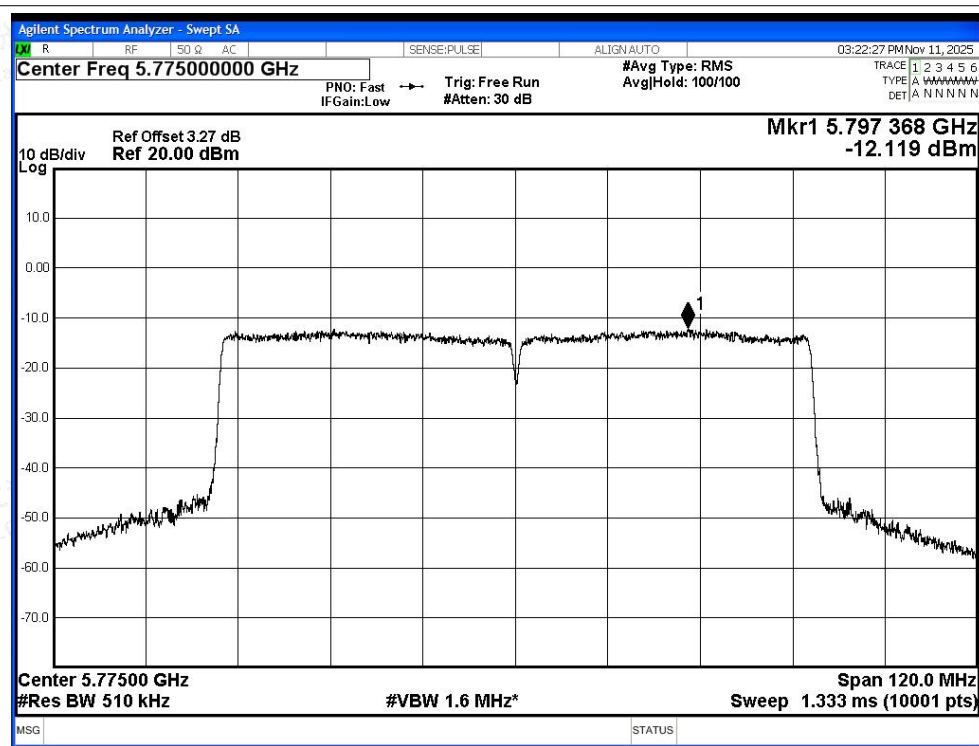


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

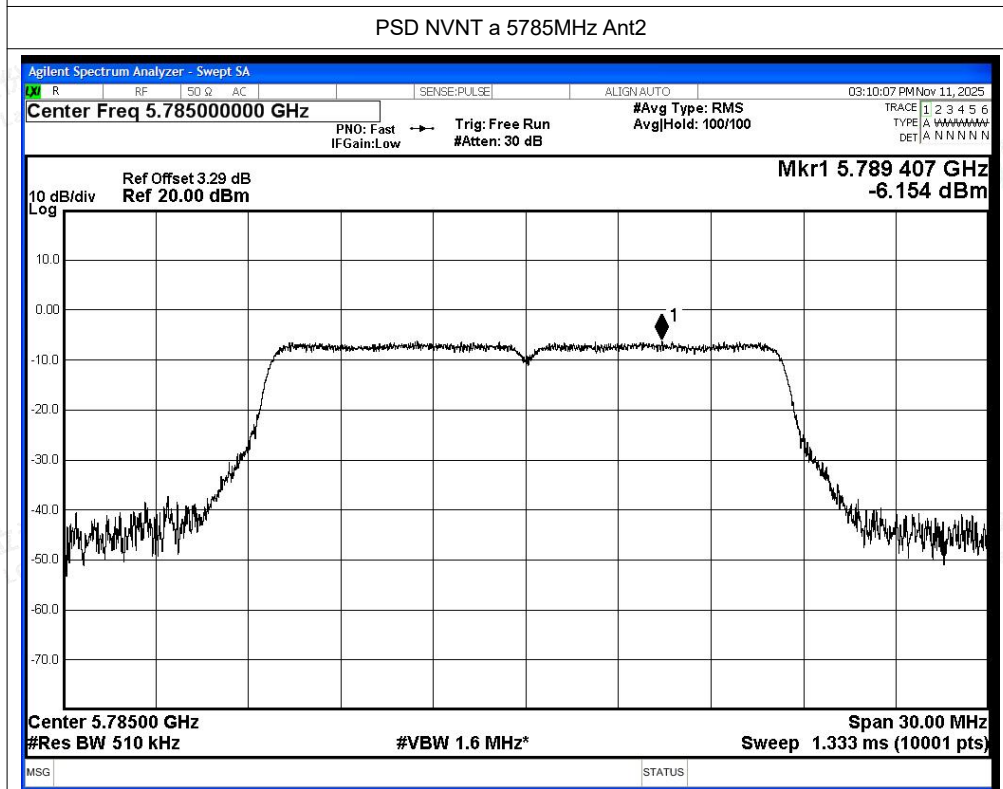
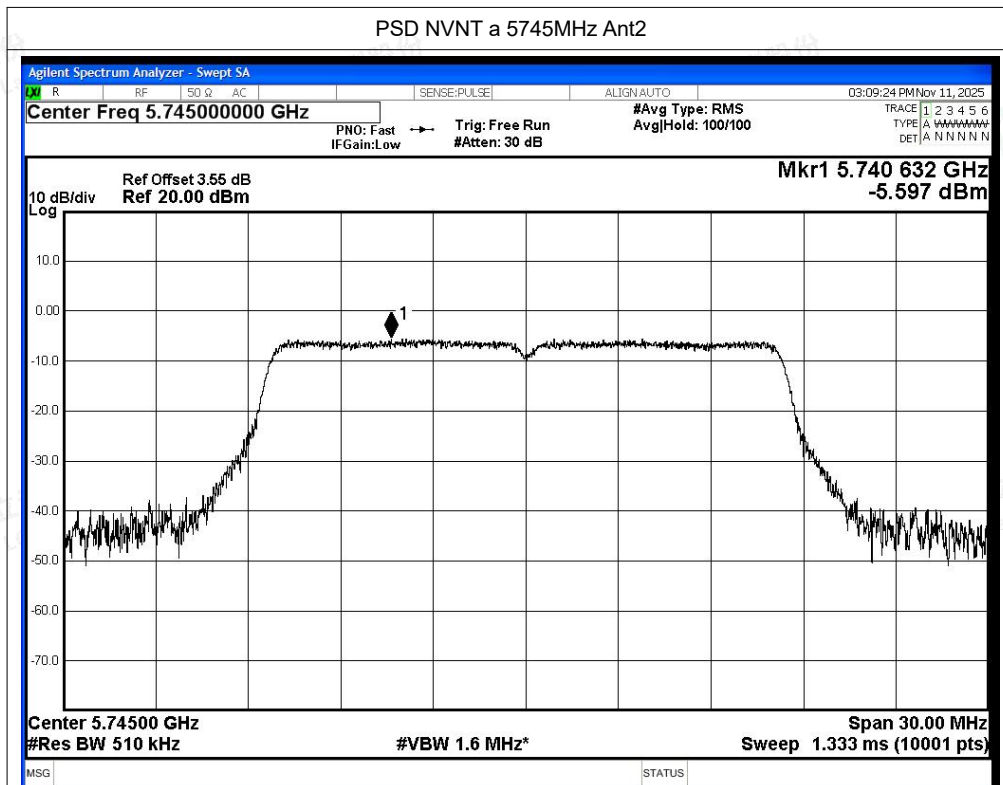


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

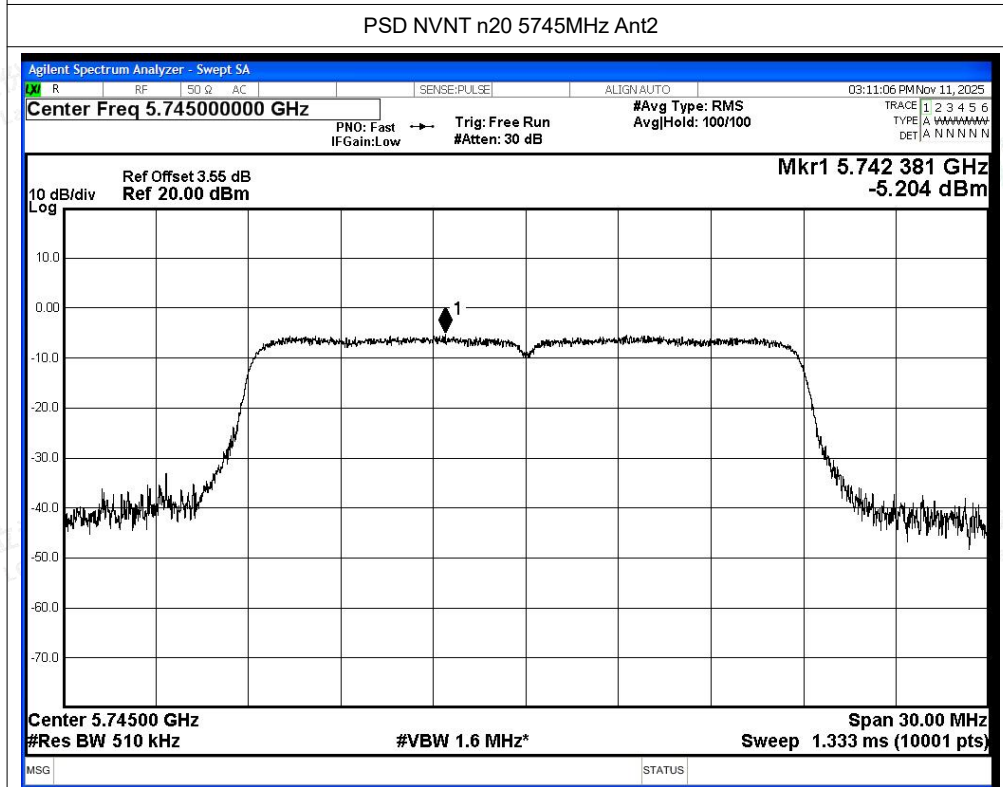
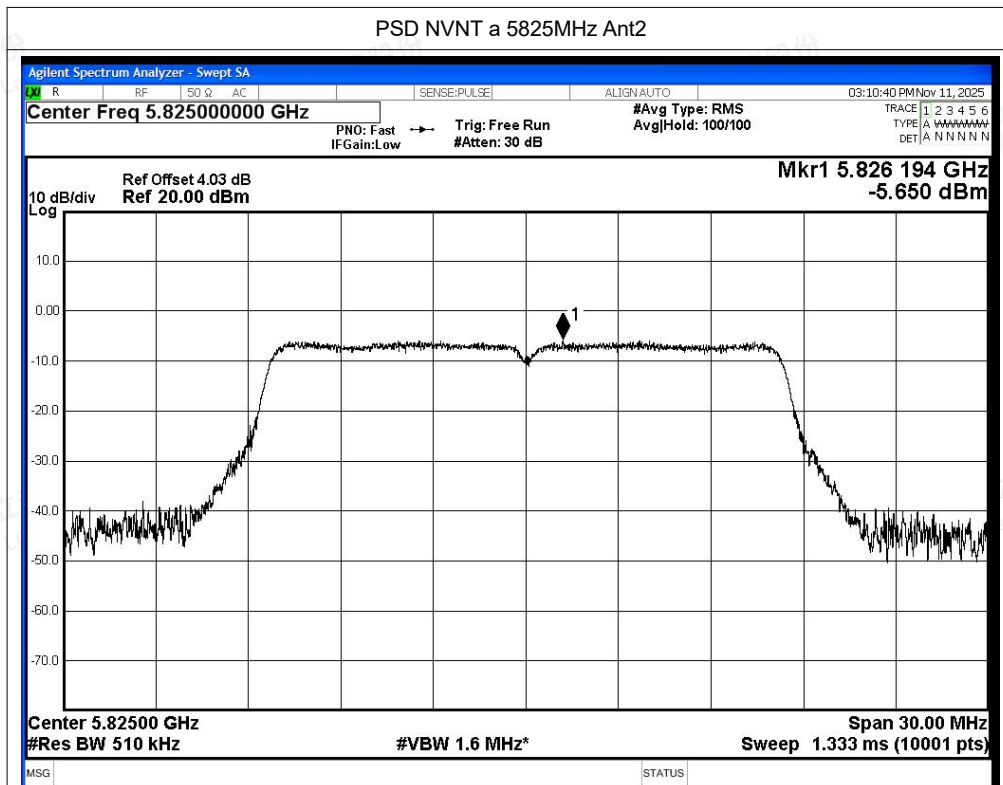


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

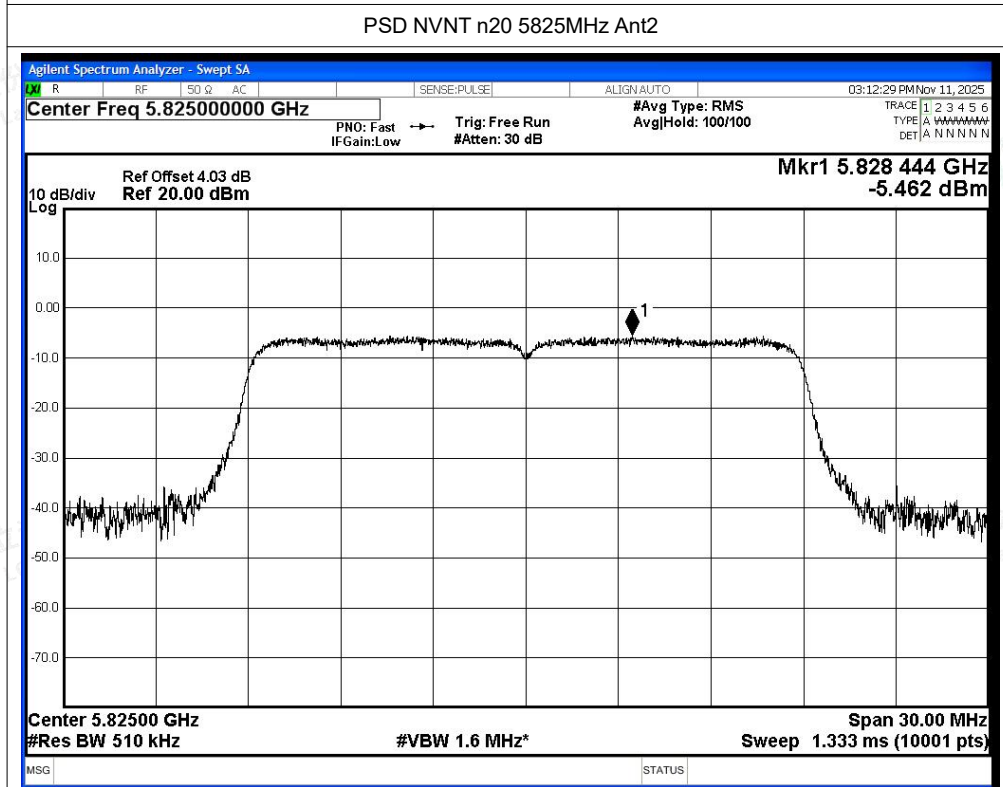
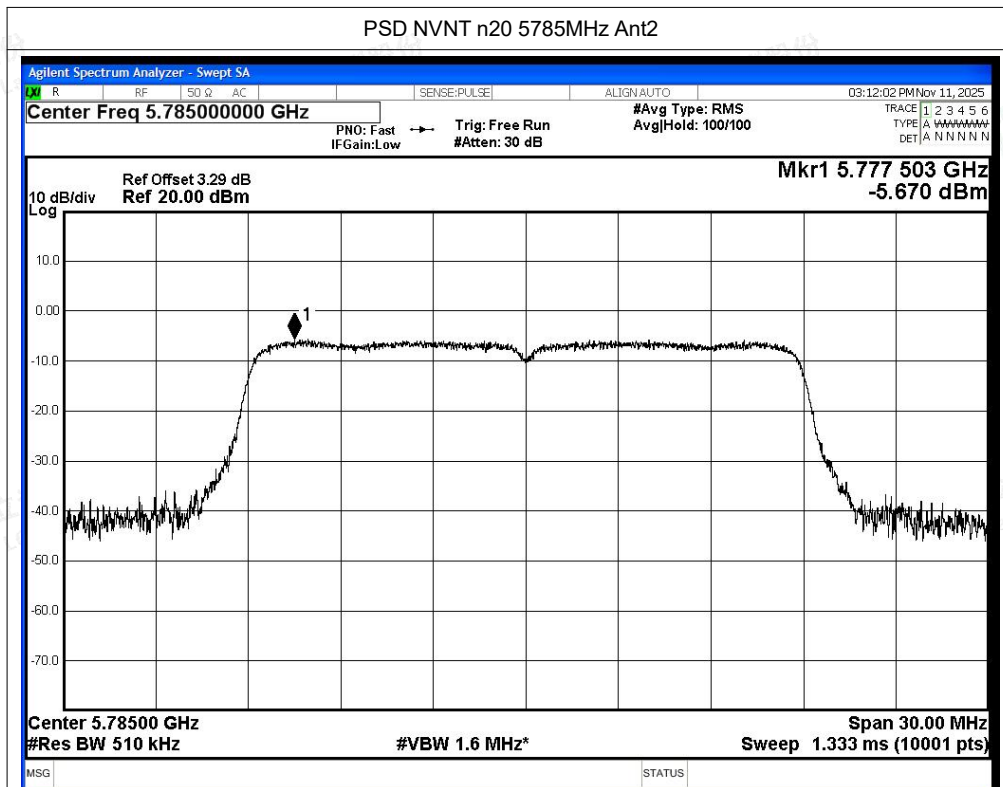


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

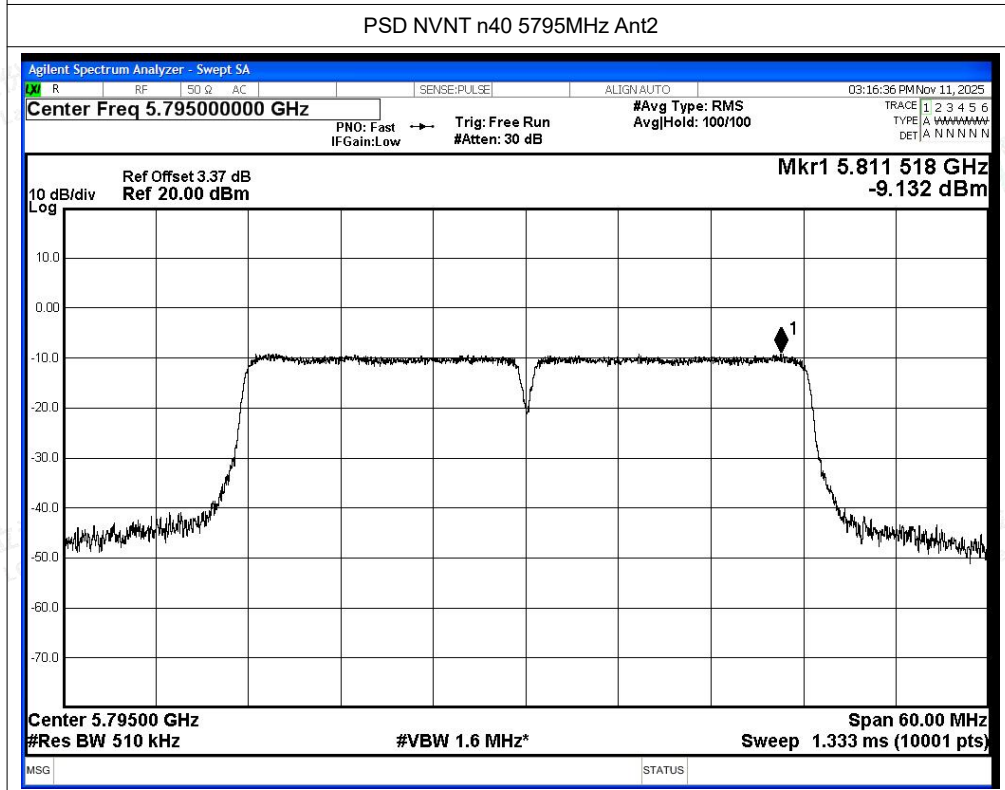
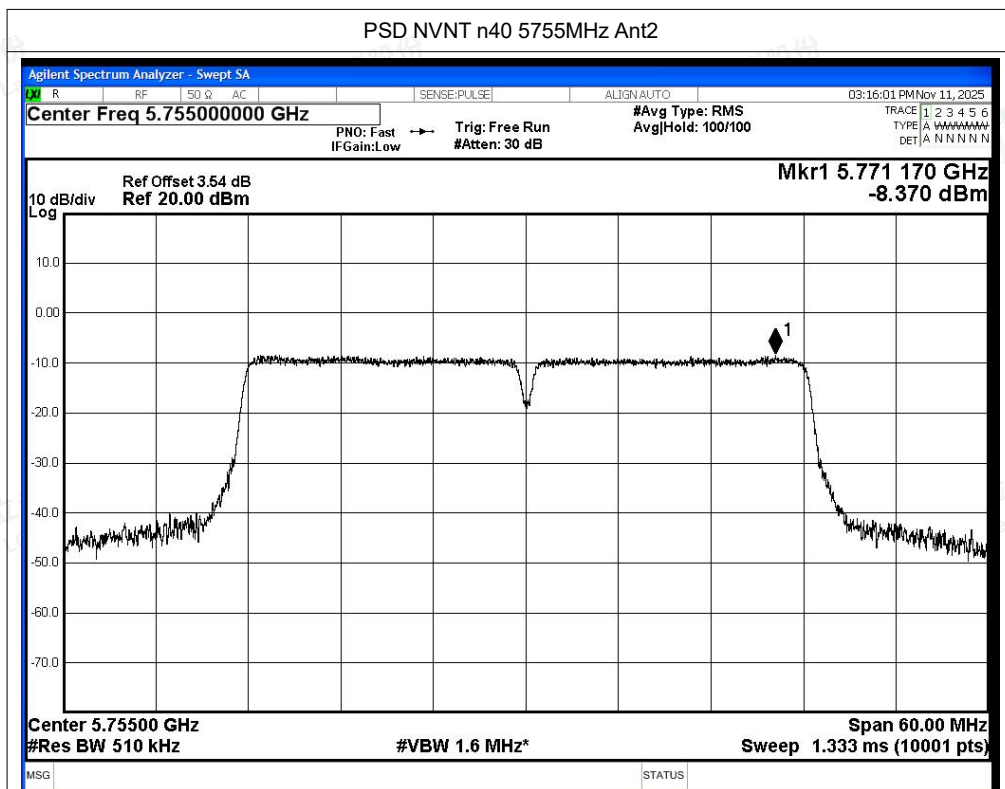


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

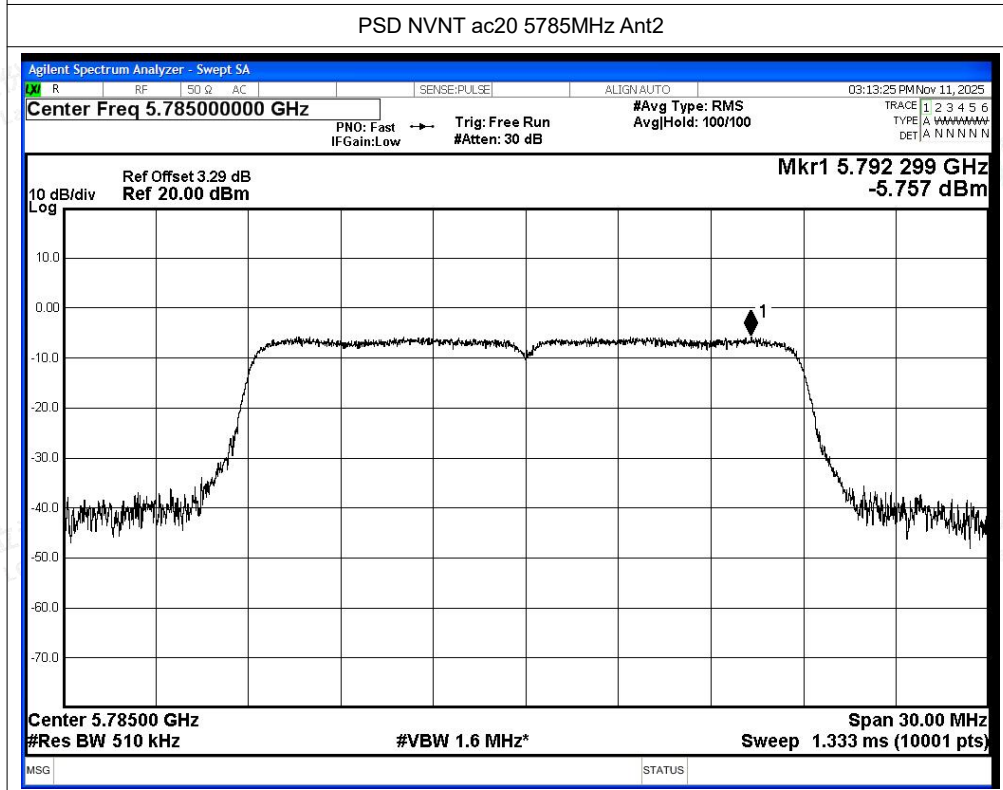
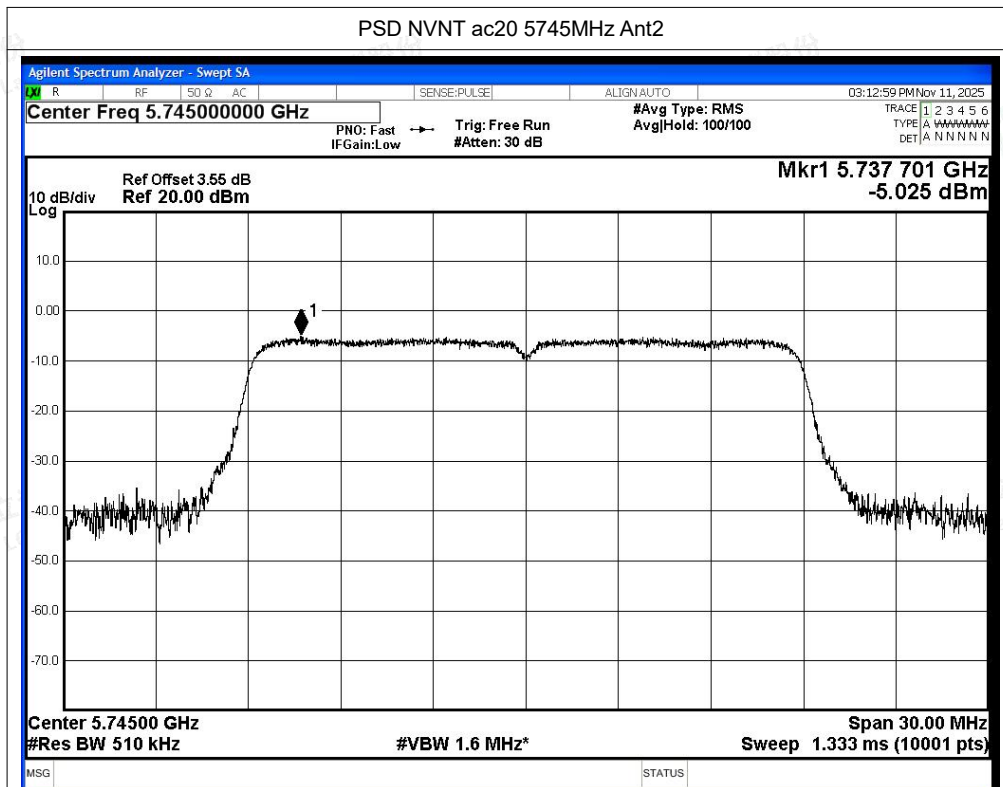


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

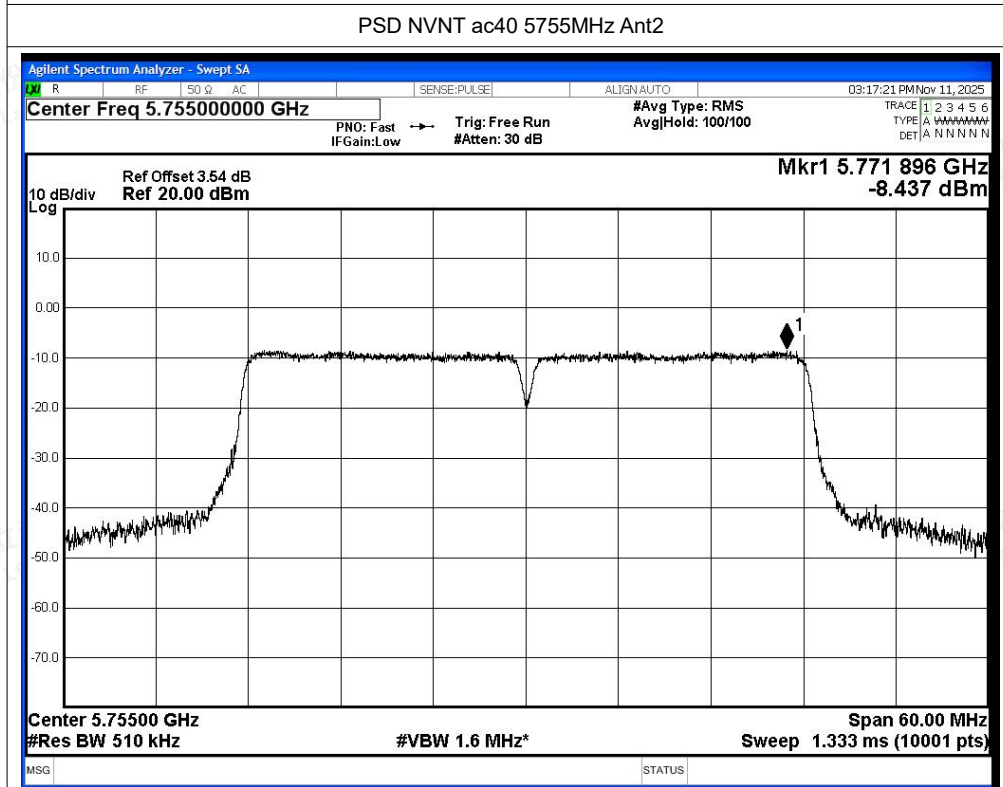
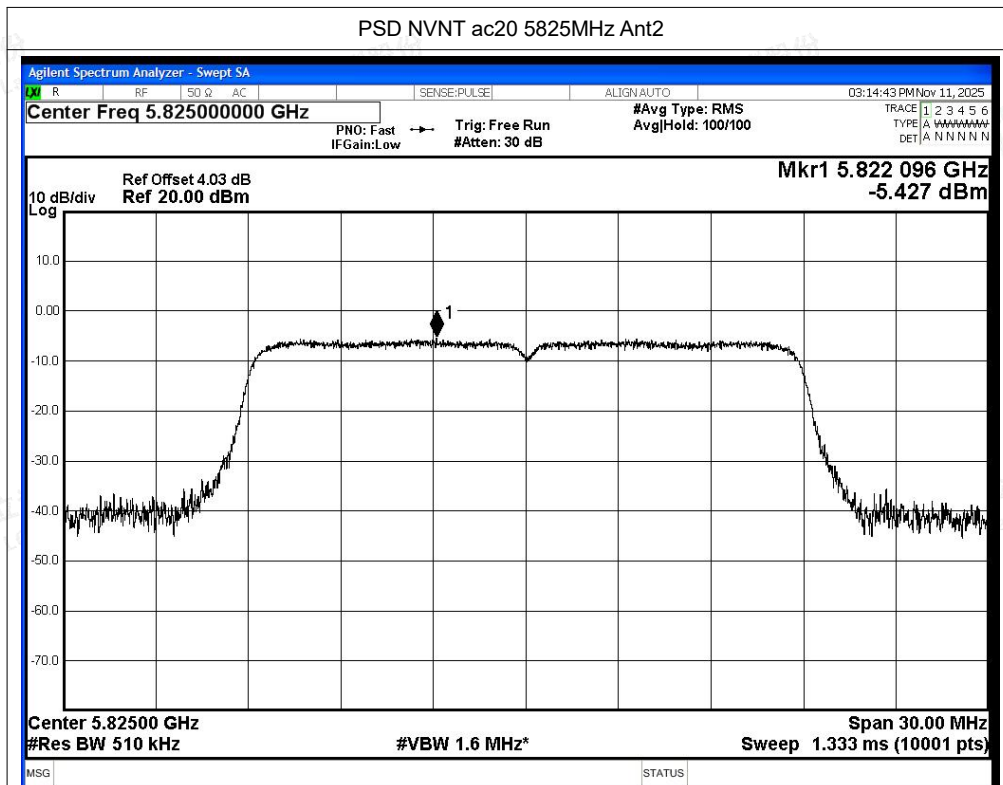


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

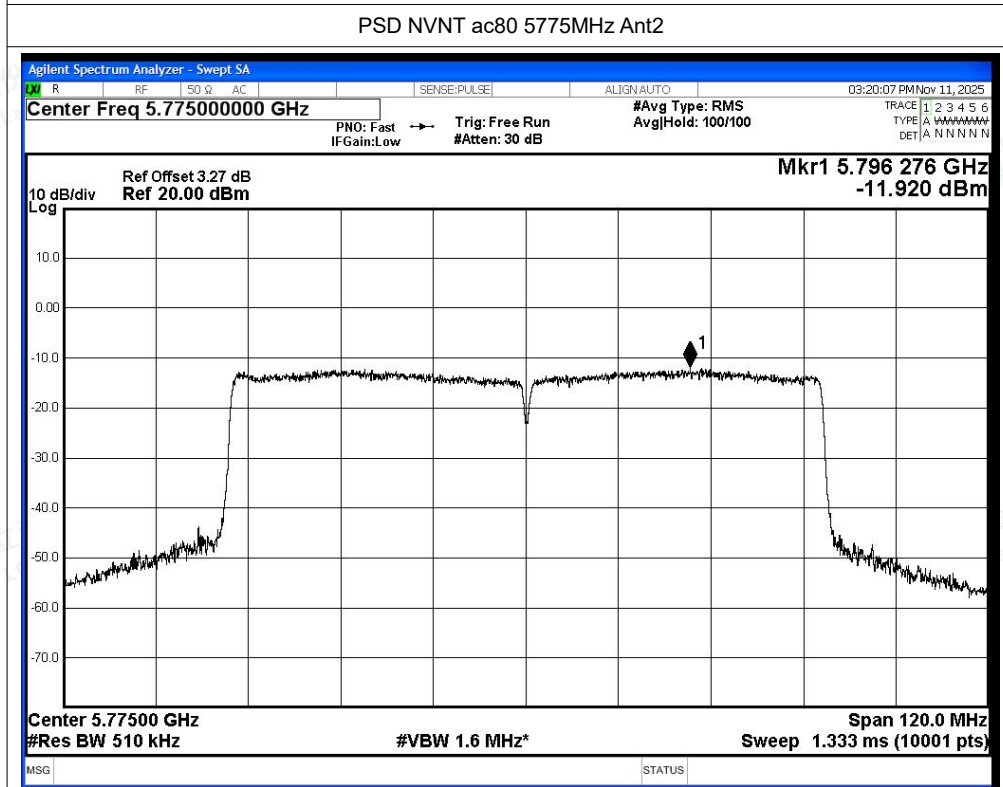
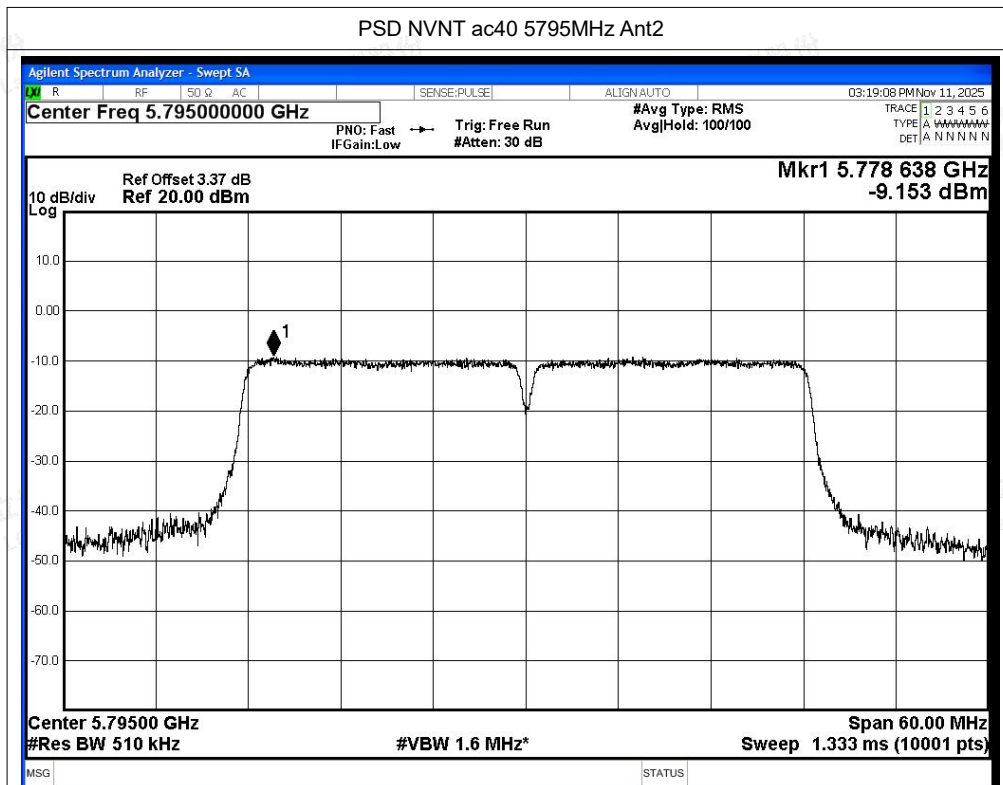


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

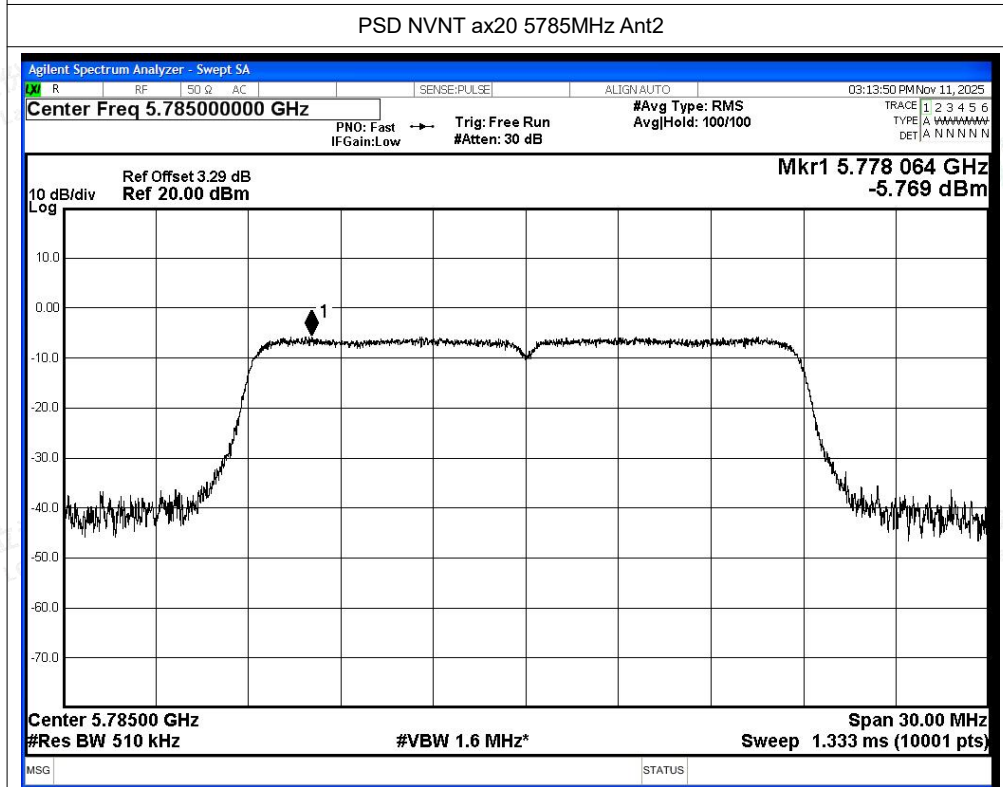
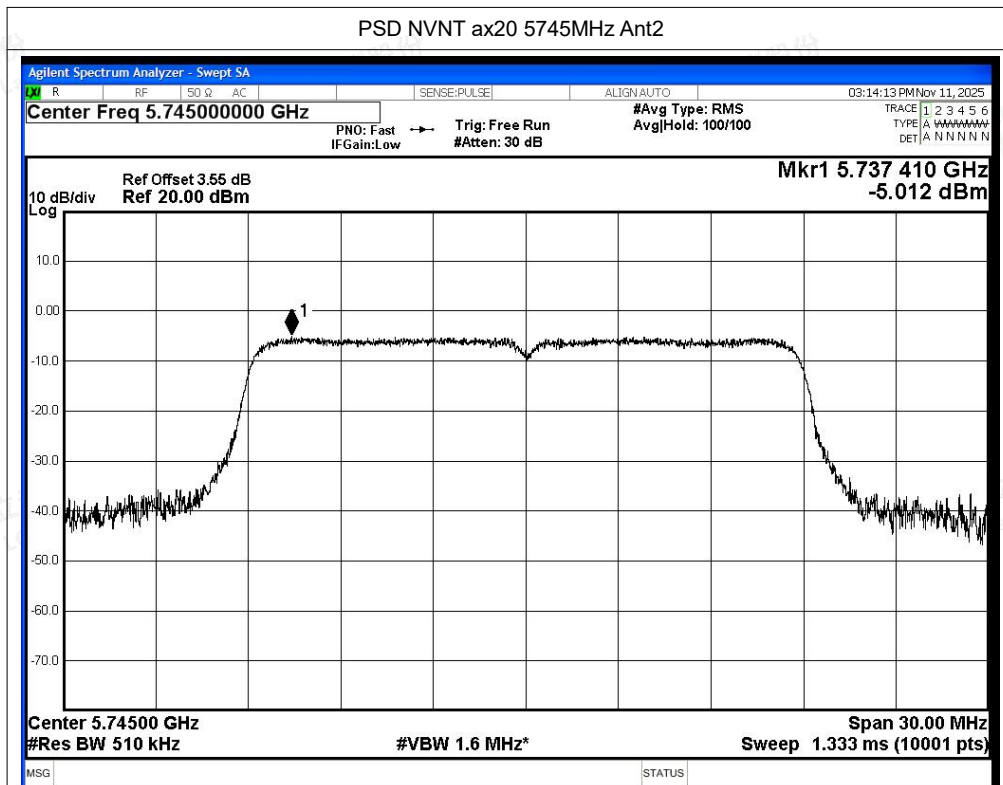




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

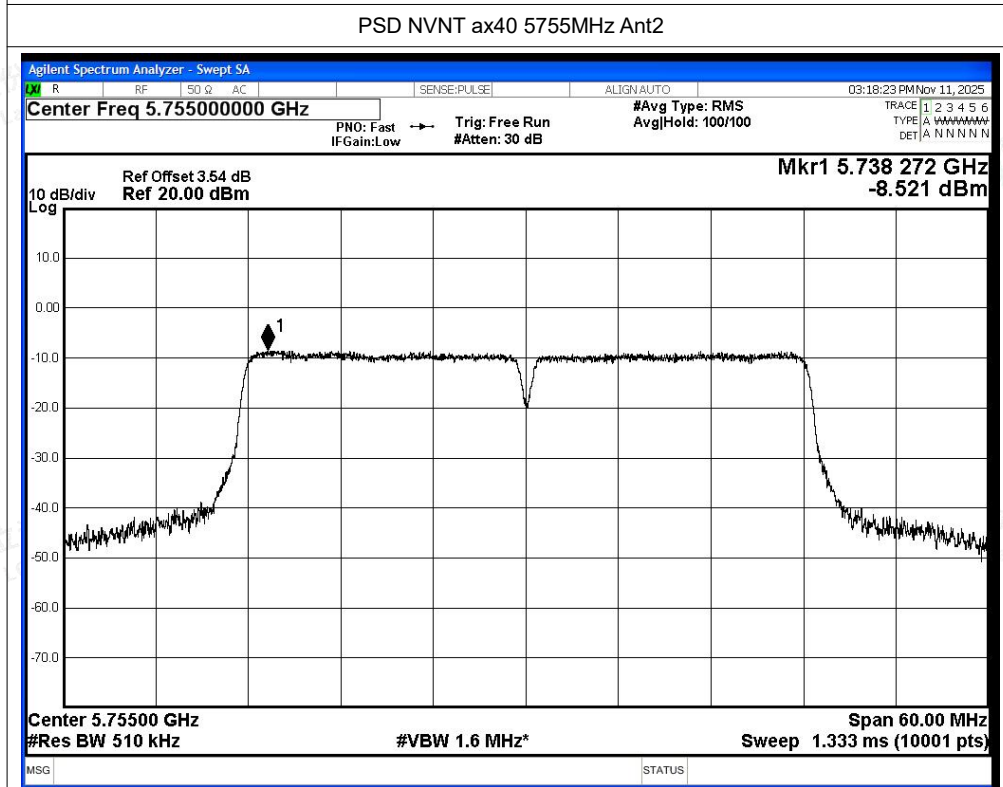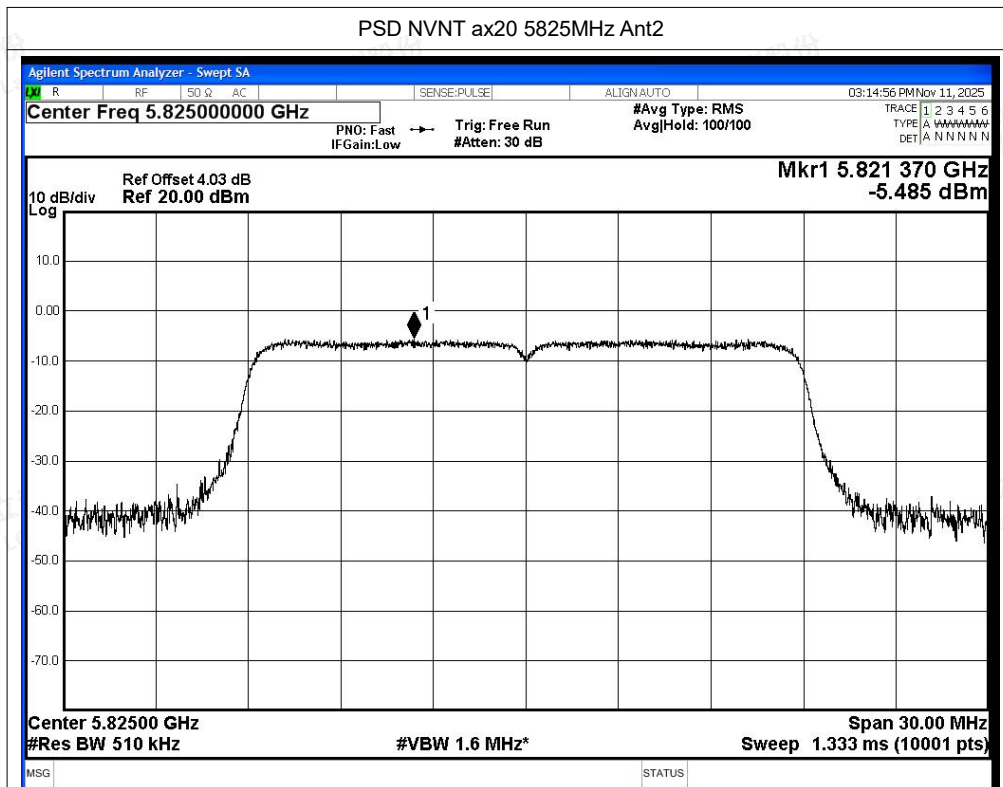

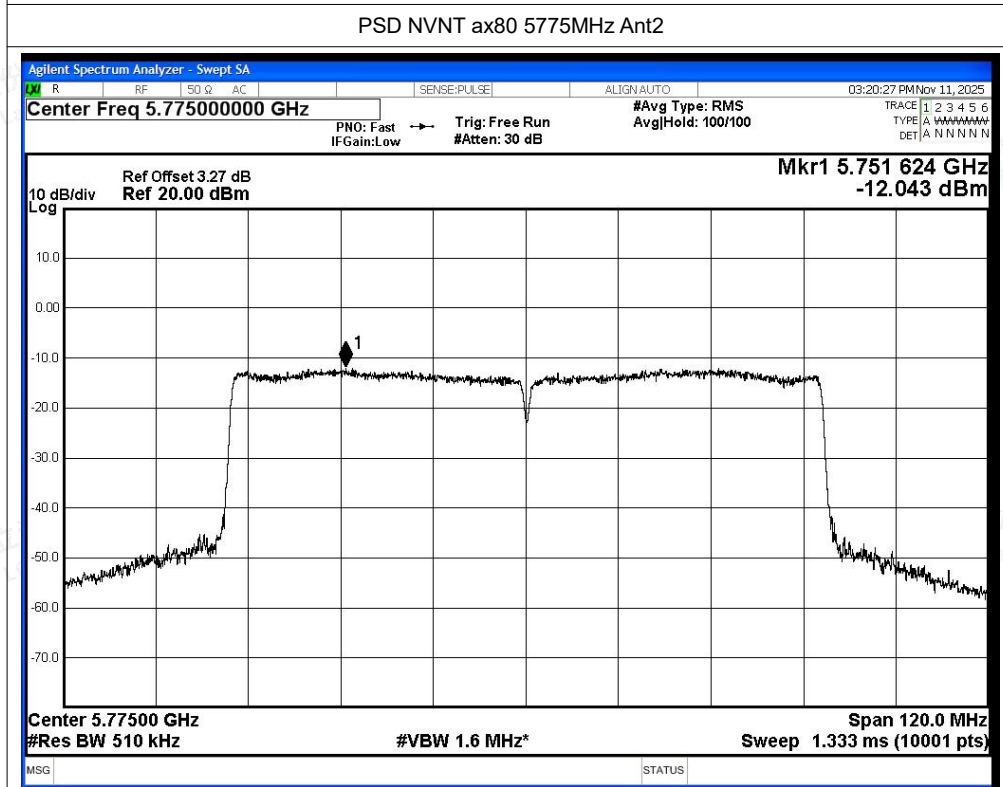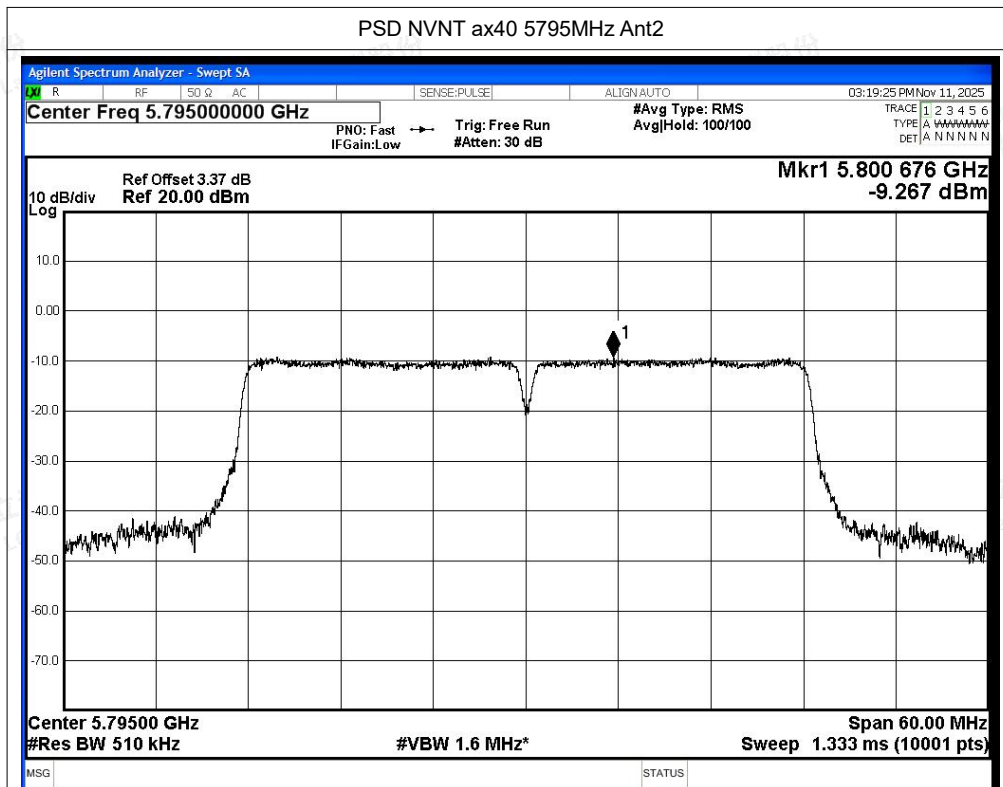

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



G.4 Restrict Band

Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	EIRP Power (dBm)	Detector	Limit (dBm)	Verdict
NVNT	a	5745	Ant1	5650	-58.17	4.55	-	-53.62	Peak	-27	Pass
NVNT	a	5745	Ant1	5650	-66.32	4.55	0.1	-61.67	Average	-27	Pass
NVNT	a	5745	Ant1	5700	-55.35	4.55	-	-50.80	Peak	10	Pass
NVNT	a	5745	Ant1	5700	-63.95	4.55	0.1	-59.30	Average	10	Pass
NVNT	a	5745	Ant1	5720	-44.56	4.55	-	-40.01	Peak	15.6	Pass
NVNT	a	5745	Ant1	5720	-56.26	4.55	0.1	-51.61	Average	15.6	Pass
NVNT	a	5745	Ant1	5725	-35.63	4.55	-	-31.08	Peak	27	Pass
NVNT	a	5745	Ant1	5725	-53.04	4.55	0.1	-48.39	Average	27	Pass
NVNT	a	5825	Ant1	5850	-41.77	4.55	-	-37.22	Peak	27	Pass
NVNT	a	5825	Ant1	5850	-55.32	4.55	0.1	-50.67	Average	27	Pass
NVNT	a	5825	Ant1	5855	-43.99	4.55	-	-39.44	Peak	15.6	Pass
NVNT	a	5825	Ant1	5855	-56.47	4.55	0.1	-51.82	Average	15.6	Pass
NVNT	a	5825	Ant1	5875	-49.88	4.55	-	-45.33	Peak	10	Pass
NVNT	a	5825	Ant1	5875	-56.5	4.55	0.1	-51.85	Average	10	Pass
NVNT	a	5825	Ant1	5925	-48.67	4.55	-	-44.12	Peak	-27	Pass
NVNT	a	5825	Ant1	5925	-57	4.55	0.1	-52.35	Average	-27	Pass
NVNT	n20	5745	Ant1	5650	-49.88	4.55	-	-45.33	Peak	-27	Pass
NVNT	n20	5745	Ant1	5650	-57.14	4.55	0.12	-52.47	Average	-27	Pass
NVNT	n20	5745	Ant1	5700	-49.17	4.55	-	-44.62	Peak	10	Pass
NVNT	n20	5745	Ant1	5700	-57.35	4.55	0.12	-52.68	Average	10	Pass
NVNT	n20	5745	Ant1	5720	-37.92	4.55	-	-33.37	Peak	15.6	Pass
NVNT	n20	5745	Ant1	5720	-53.73	4.55	0.12	-49.06	Average	15.6	Pass
NVNT	n20	5745	Ant1	5725	-33.4	4.55	-	-28.85	Peak	27	Pass
NVNT	n20	5745	Ant1	5725	-48.11	4.55	0.12	-43.44	Average	27	Pass
NVNT	n20	5825	Ant1	5850	-40.07	4.55	-	-35.52	Peak	27	Pass
NVNT	n20	5825	Ant1	5850	-54.42	4.55	0.12	-49.75	Average	27	Pass
NVNT	n20	5825	Ant1	5855	-42.78	4.55	-	-38.23	Peak	15.6	Pass
NVNT	n20	5825	Ant1	5855	-55.34	4.55	0.12	-50.67	Average	15.6	Pass
NVNT	n20	5825	Ant1	5875	-49.33	4.55	-	-44.78	Peak	10	Pass
NVNT	n20	5825	Ant1	5875	-56.88	4.55	0.12	-52.21	Average	10	Pass
NVNT	n20	5825	Ant1	5925	-47.9	4.55	-	-43.35	Peak	-27	Pass
NVNT	n20	5825	Ant1	5925	-56.19	4.55	0.12	-51.52	Average	-27	Pass
NVNT	n40	5755	Ant1	5650	-50.61	4.55	-	-46.06	Peak	-27	Pass
NVNT	n40	5755	Ant1	5650	-57.73	4.55	0.24	-52.94	Average	-27	Pass
NVNT	n40	5755	Ant1	5700	-49.62	4.55	-	-45.07	Peak	10	Pass
NVNT	n40	5755	Ant1	5700	-57.88	4.55	0.24	-53.09	Average	10	Pass
NVNT	n40	5755	Ant1	5720	-40.15	4.55	-	-35.60	Peak	15.6	Pass
NVNT	n40	5755	Ant1	5720	-52.8	4.55	0.24	-48.01	Average	15.6	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	n40	5755	Ant1	5725	-32.95	4.55	-	-28.40	Peak	27	Pass
NVNT	n40	5755	Ant1	5725	-49.31	4.55	0.24	-44.52	Average	27	Pass
NVNT	n40	5795	Ant1	5850	-50.08	4.55	-	-45.53	Peak	27	Pass
NVNT	n40	5795	Ant1	5850	-57.67	4.55	0.24	-52.88	Average	27	Pass
NVNT	n40	5795	Ant1	5855	-49.11	4.55	-	-44.56	Peak	15.6	Pass
NVNT	n40	5795	Ant1	5855	-57.96	4.55	0.24	-53.17	Average	15.6	Pass
NVNT	n40	5795	Ant1	5875	-49.38	4.55	-	-44.83	Peak	10	Pass
NVNT	n40	5795	Ant1	5875	-57.82	4.55	0.24	-53.03	Average	10	Pass
NVNT	n40	5795	Ant1	5925	-48.65	4.55	-	-44.10	Peak	-27	Pass
NVNT	n40	5795	Ant1	5925	-56.91	4.55	0.24	-52.12	Average	-27	Pass
NVNT	ac20	5745	Ant1	5650	-49.93	4.55	-	-45.38	Peak	-27	Pass
NVNT	ac20	5745	Ant1	5650	-58	4.55	0.12	-53.33	Average	-27	Pass
NVNT	ac20	5745	Ant1	5700	-49.4	4.55	-	-44.85	Peak	10	Pass
NVNT	ac20	5745	Ant1	5700	-56.84	4.55	0.12	-52.17	Average	10	Pass
NVNT	ac20	5745	Ant1	5720	-40.26	4.55	-	-35.71	Peak	15.6	Pass
NVNT	ac20	5745	Ant1	5720	-52.7	4.55	0.12	-48.03	Average	15.6	Pass
NVNT	ac20	5745	Ant1	5725	-29.76	4.55	-	-25.21	Peak	27	Pass
NVNT	ac20	5745	Ant1	5725	-46.47	4.55	0.12	-41.80	Average	27	Pass
NVNT	ac20	5825	Ant1	5850	-40.53	4.55	-	-35.98	Peak	27	Pass
NVNT	ac20	5825	Ant1	5850	-53.05	4.55	0.12	-48.38	Average	27	Pass
NVNT	ac20	5825	Ant1	5855	-41.96	4.55	-	-37.41	Peak	15.6	Pass
NVNT	ac20	5825	Ant1	5855	-56.2	4.55	0.12	-51.53	Average	15.6	Pass
NVNT	ac20	5825	Ant1	5875	-49.1	4.55	-	-44.55	Peak	10	Pass
NVNT	ac20	5825	Ant1	5875	-56.45	4.55	0.12	-51.78	Average	10	Pass
NVNT	ac20	5825	Ant1	5925	-48.05	4.55	-	-43.50	Peak	-27	Pass
NVNT	ac20	5825	Ant1	5925	-56.7	4.55	0.12	-52.03	Average	-27	Pass
NVNT	ac40	5755	Ant1	5650	-48.27	4.55	-	-43.72	Peak	-27	Pass
NVNT	ac40	5755	Ant1	5650	-57.55	4.55	0.24	-52.76	Average	-27	Pass
NVNT	ac40	5755	Ant1	5700	-50.22	4.55	-	-45.67	Peak	10	Pass
NVNT	ac40	5755	Ant1	5700	-57.34	4.55	0.24	-52.55	Average	10	Pass
NVNT	ac40	5755	Ant1	5720	-40.59	4.55	-	-36.04	Peak	15.6	Pass
NVNT	ac40	5755	Ant1	5720	-52.15	4.55	0.24	-47.36	Average	15.6	Pass
NVNT	ac40	5755	Ant1	5725	-36.23	4.55	-	-31.68	Peak	27	Pass
NVNT	ac40	5755	Ant1	5725	-48.8	4.55	0.24	-44.01	Average	27	Pass
NVNT	ac40	5795	Ant1	5850	-50.17	4.55	-	-45.62	Peak	27	Pass
NVNT	ac40	5795	Ant1	5850	-58.11	4.55	0.24	-53.32	Average	27	Pass
NVNT	ac40	5795	Ant1	5855	-48.83	4.55	-	-44.28	Peak	15.6	Pass
NVNT	ac40	5795	Ant1	5855	-57.52	4.55	0.24	-52.73	Average	15.6	Pass
NVNT	ac40	5795	Ant1	5875	-50.49	4.55	-	-45.94	Peak	10	Pass
NVNT	ac40	5795	Ant1	5875	-58.02	4.55	0.24	-53.23	Average	10	Pass
NVNT	ac40	5795	Ant1	5925	-48.01	4.55	-	-43.46	Peak	-27	Pass
NVNT	ac40	5795	Ant1	5925	-57.16	4.55	0.24	-52.37	Average	-27	Pass
NVNT	ac80	5775	Ant1	5850	-49.36	4.55	-	-44.81	Peak	27	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac80	5775	Ant1	5850	-57.59	4.55	0.47	-52.57	Average	27	Pass
NVNT	ac80	5775	Ant1	5855	-49.9	4.55	-	-45.35	Peak	15.6	Pass
NVNT	ac80	5775	Ant1	5855	-57.58	4.55	0.47	-52.56	Average	15.6	Pass
NVNT	ac80	5775	Ant1	5875	-49.19	4.55	-	-44.64	Peak	10	Pass
NVNT	ac80	5775	Ant1	5875	-57.93	4.55	0.47	-52.91	Average	10	Pass
NVNT	ac80	5775	Ant1	5925	-47.92	4.55	-	-43.37	Peak	-27	Pass
NVNT	ac80	5775	Ant1	5925	-56.83	4.55	0.47	-51.81	Average	-27	Pass
NVNT	ac80	5775	Ant1	5650	-50.23	4.55	-	-45.68	Peak	-27	Pass
NVNT	ac80	5775	Ant1	5650	-57.69	4.55	0.47	-52.67	Average	-27	Pass
NVNT	ac80	5775	Ant1	5700	-49.08	4.55	-	-44.53	Peak	10	Pass
NVNT	ac80	5775	Ant1	5700	-57.23	4.55	0.47	-52.21	Average	10	Pass
NVNT	ac80	5775	Ant1	5720	-39.42	4.55	-	-34.87	Peak	15.6	Pass
NVNT	ac80	5775	Ant1	5720	-53.85	4.55	0.47	-48.83	Average	15.6	Pass
NVNT	ac80	5775	Ant1	5725	-37.5	4.55	-	-32.95	Peak	27	Pass
NVNT	ac80	5775	Ant1	5725	-52.07	4.55	0.47	-47.05	Average	27	Pass
NVNT	ax20	5745	Ant1	5650	-48.73	4.55	-	-44.18	Peak	-27	Pass
NVNT	ax20	5745	Ant1	5650	-57.62	4.55	0.12	-52.95	Average	-27	Pass
NVNT	ax20	5745	Ant1	5700	-49.15	4.55	-	-44.60	Peak	10	Pass
NVNT	ax20	5745	Ant1	5700	-57.2	4.55	0.12	-52.53	Average	10	Pass
NVNT	ax20	5745	Ant1	5720	-40.18	4.55	-	-35.63	Peak	15.6	Pass
NVNT	ax20	5745	Ant1	5720	-52.47	4.55	0.12	-47.80	Average	15.6	Pass
NVNT	ax20	5745	Ant1	5725	-31.99	4.55	-	-27.44	Peak	27	Pass
NVNT	ax20	5745	Ant1	5725	-48.71	4.55	0.12	-44.04	Average	27	Pass
NVNT	ax20	5825	Ant1	5850	-40.06	4.55	-	-35.51	Peak	27	Pass
NVNT	ax20	5825	Ant1	5850	-52.2	4.55	0	-47.65	Average	27	Pass
NVNT	ax20	5825	Ant1	5855	-46.77	4.55	-	-42.22	Peak	15.6	Pass
NVNT	ax20	5825	Ant1	5855	-55.66	4.55	0	-51.11	Average	15.6	Pass
NVNT	ax20	5825	Ant1	5875	-48.69	4.55	-	-44.14	Peak	10	Pass
NVNT	ax20	5825	Ant1	5875	-56.65	4.55	0	-52.10	Average	10	Pass
NVNT	ax20	5825	Ant1	5925	-48.31	4.55	-	-43.76	Peak	-27	Pass
NVNT	ax20	5825	Ant1	5925	-56.76	4.55	0	-52.21	Average	-27	Pass
NVNT	ax40	5755	Ant1	5650	-49.17	4.55	-	-44.62	Peak	-27	Pass
NVNT	ax40	5755	Ant1	5650	-57.03	4.55	0.23	-52.25	Average	-27	Pass
NVNT	ax40	5755	Ant1	5700	-49.97	4.55	-	-45.42	Peak	10	Pass
NVNT	ax40	5755	Ant1	5700	-57.22	4.55	0.23	-52.44	Average	10	Pass
NVNT	ax40	5755	Ant1	5720	-38.57	4.55	-	-34.02	Peak	15.6	Pass
NVNT	ax40	5755	Ant1	5720	-53.04	4.55	0.23	-48.26	Average	15.6	Pass
NVNT	ax40	5755	Ant1	5725	-33.73	4.55	-	-29.18	Peak	27	Pass
NVNT	ax40	5755	Ant1	5725	-49.87	4.55	0.23	-45.09	Average	27	Pass
NVNT	ax40	5795	Ant1	5850	-50.07	4.55	-	-45.52	Peak	27	Pass
NVNT	ax40	5795	Ant1	5850	-58.7	4.55	0.24	-53.91	Average	27	Pass
NVNT	ax40	5795	Ant1	5855	-49.04	4.55	-	-44.49	Peak	15.6	Pass
NVNT	ax40	5795	Ant1	5855	-57.26	4.55	0.24	-52.47	Average	15.6	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




NVNT	ax40	5795	Ant1	5875	-50.67	4.55	-	-46.12	Peak	10	Pass
NVNT	ax40	5795	Ant1	5875	-57.66	4.55	0.24	-52.87	Average	10	Pass
NVNT	ax40	5795	Ant1	5925	-48.37	4.55	-	-43.82	Peak	-27	Pass
NVNT	ax40	5795	Ant1	5925	-57.63	4.55	0.24	-52.84	Average	-27	Pass
NVNT	ax80	5775	Ant1	5850	-50.6	4.55	-	-46.05	Peak	27	Pass
NVNT	ax80	5775	Ant1	5850	-57.02	4.55	0	-52.47	Average	27	Pass
NVNT	ax80	5775	Ant1	5855	-48.73	4.55	-	-44.18	Peak	15.6	Pass
NVNT	ax80	5775	Ant1	5855	-57.84	4.55	0	-53.29	Average	15.6	Pass
NVNT	ax80	5775	Ant1	5875	-48	4.55	-	-43.45	Peak	10	Pass
NVNT	ax80	5775	Ant1	5875	-57.7	4.55	0	-53.15	Average	10	Pass
NVNT	ax80	5775	Ant1	5925	-49.86	4.55	-	-45.31	Peak	-27	Pass
NVNT	ax80	5775	Ant1	5925	-57.41	4.55	0	-52.86	Average	-27	Pass
NVNT	ax80	5775	Ant1	5650	-49.03	4.55	-	-44.48	Peak	-27	Pass
NVNT	ax80	5775	Ant1	5650	-57.65	4.55	0	-53.10	Average	-27	Pass
NVNT	ax80	5775	Ant1	5700	-48.88	4.55	-	-44.33	Peak	10	Pass
NVNT	ax80	5775	Ant1	5700	-57.15	4.55	0	-52.60	Average	10	Pass
NVNT	ax80	5775	Ant1	5720	-38.4	4.55	-	-33.85	Peak	15.6	Pass
NVNT	ax80	5775	Ant1	5720	-53.92	4.55	0	-49.37	Average	15.6	Pass
NVNT	ax80	5775	Ant1	5725	-37.58	4.55	-	-33.03	Peak	27	Pass
NVNT	ax80	5775	Ant1	5725	-51.61	4.55	0	-47.06	Average	27	Pass






Test Graphs

Restrict Band NVNT a 5745MHz Ant1 Peak

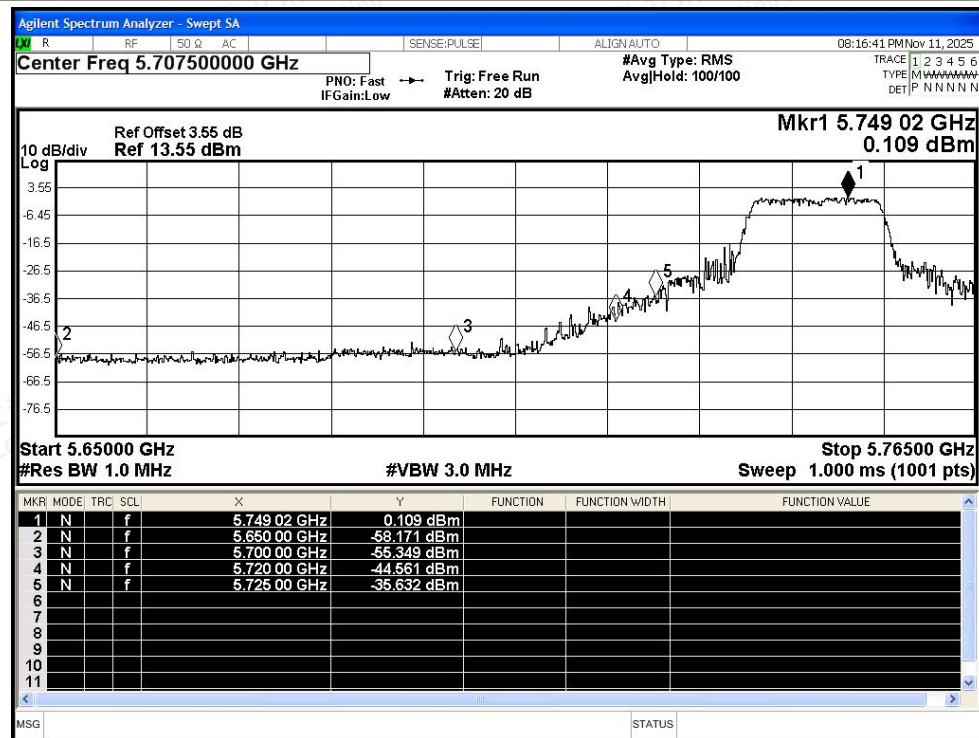

Restrict Band NVNT a 5745MHz Ant1 Average

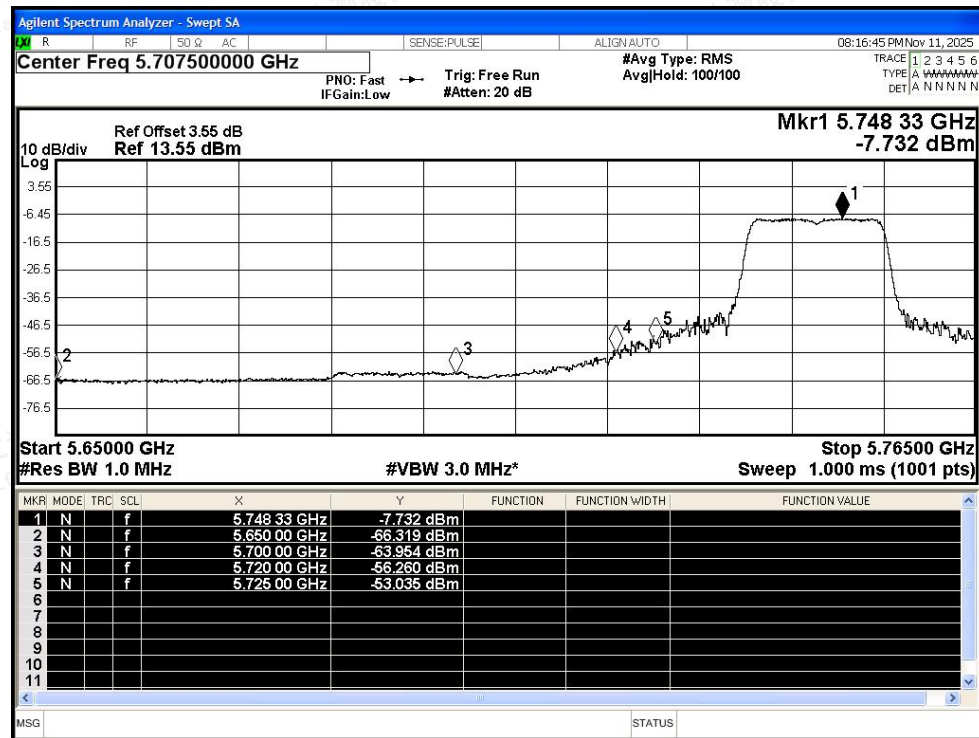

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5825MHz Ant1 Peak

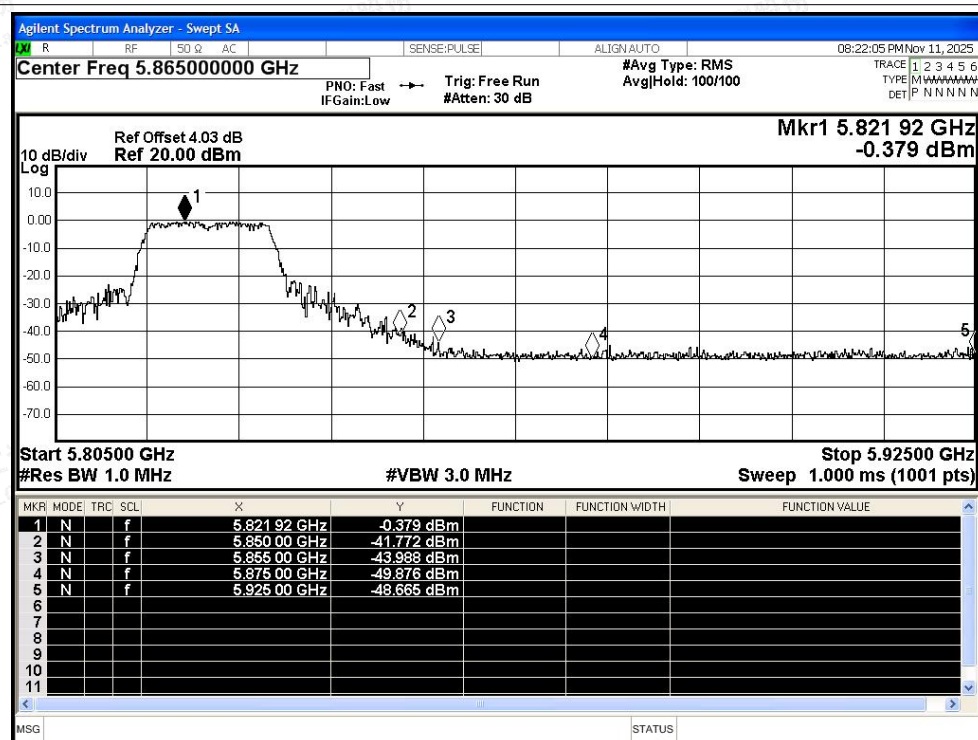

Restrict Band NVNT a 5825MHz Ant1 Average

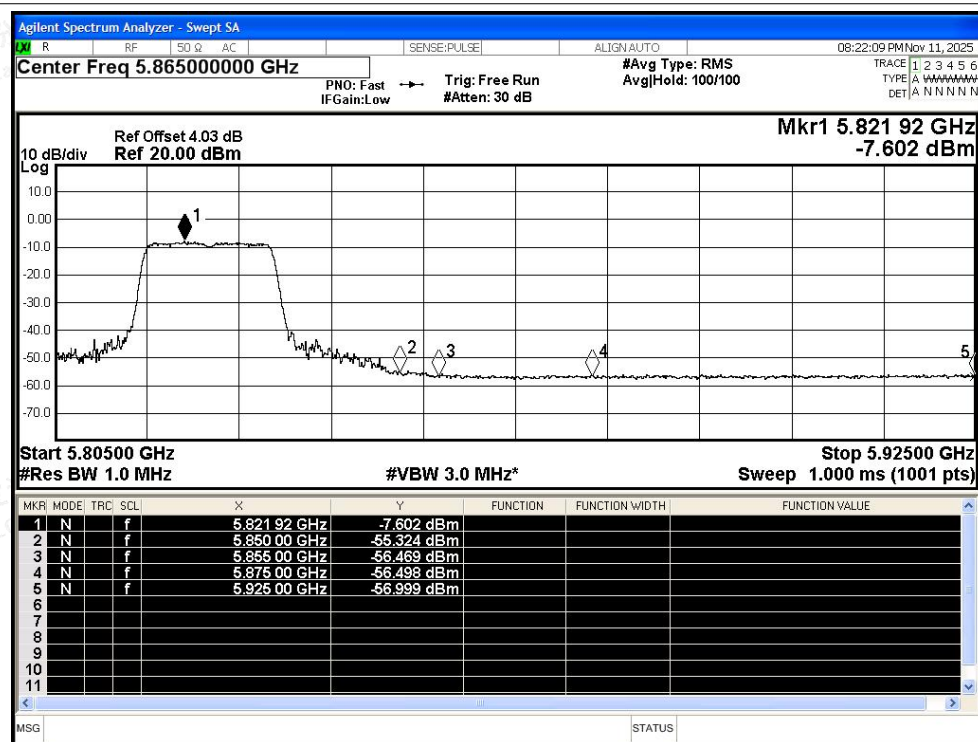

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5745MHz Ant1 Peak

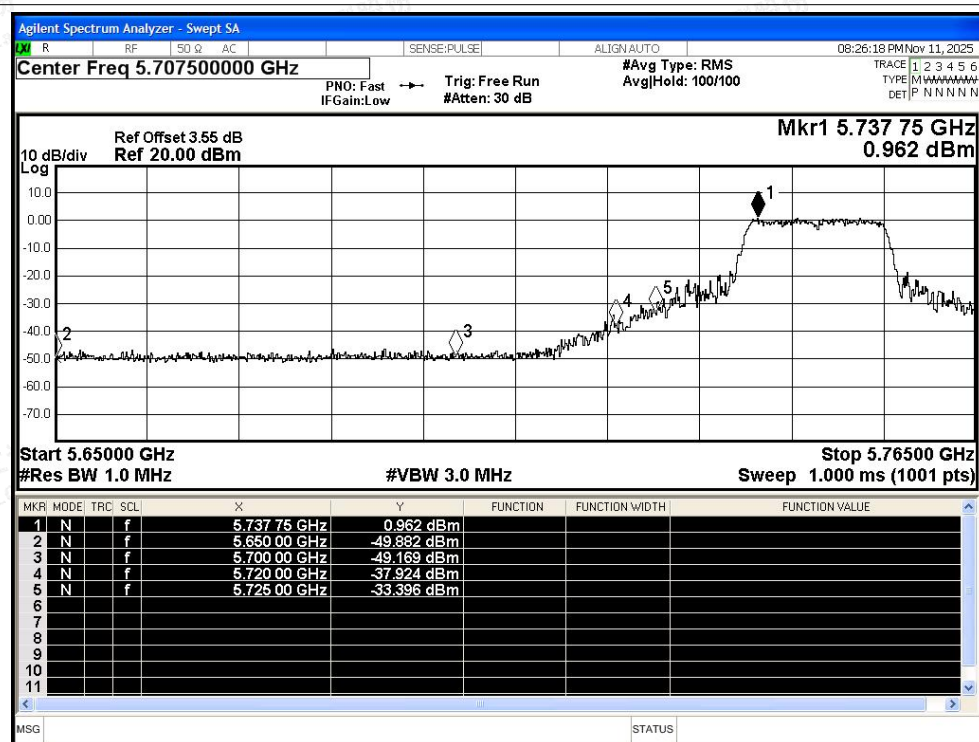

Restrict Band NVNT n20 5745MHz Ant1 Average

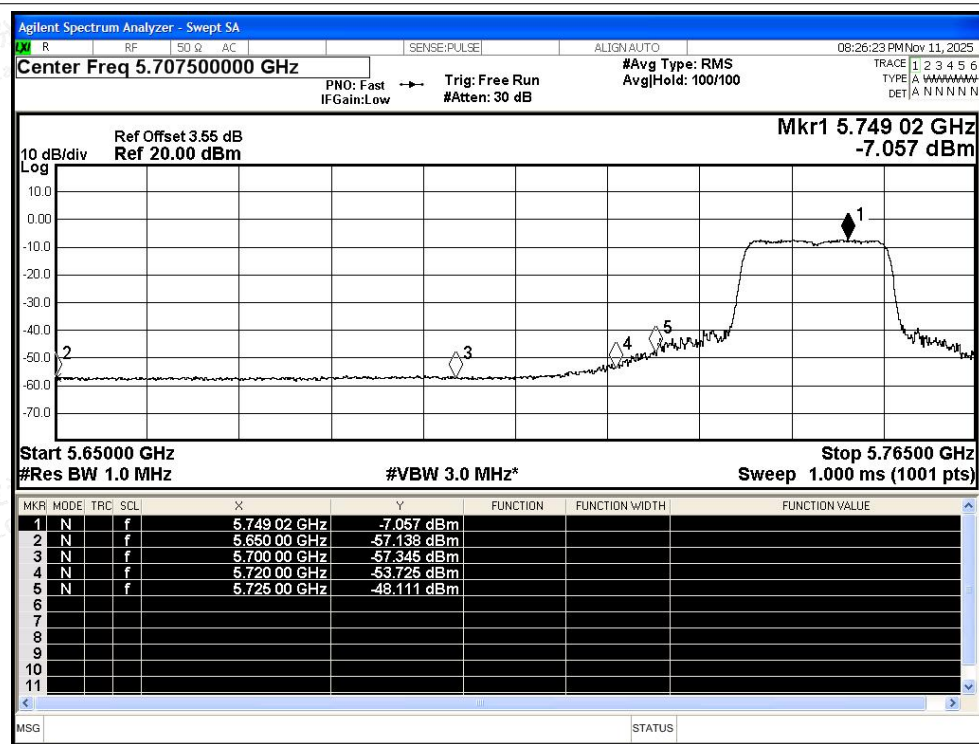

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5825MHz Ant1 Peak

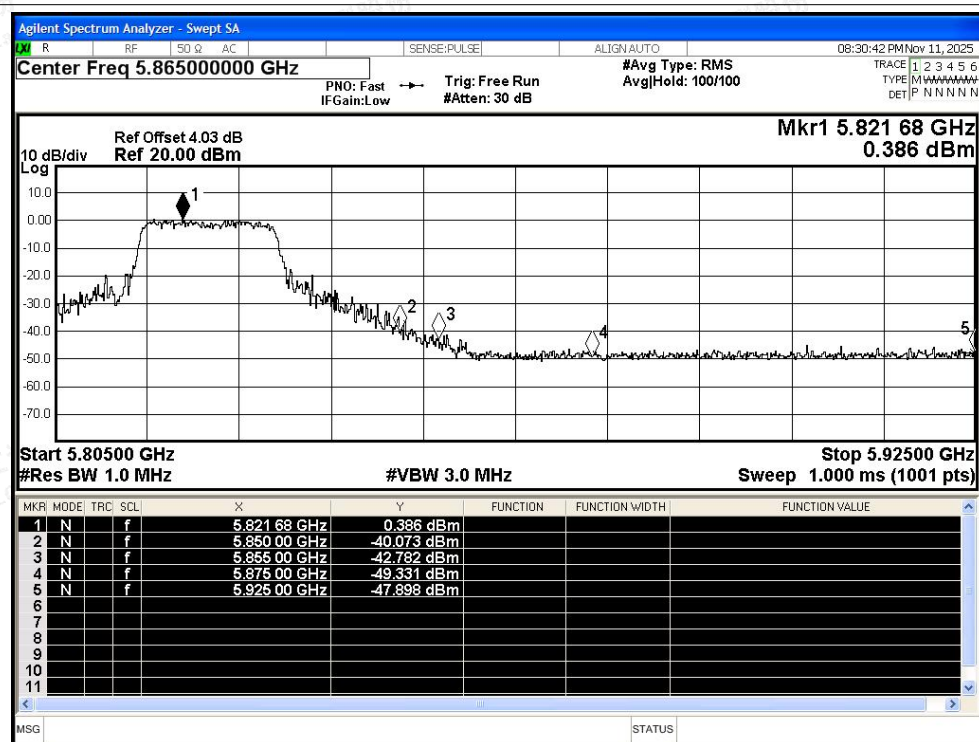

Restrict Band NVNT n20 5825MHz Ant1 Average

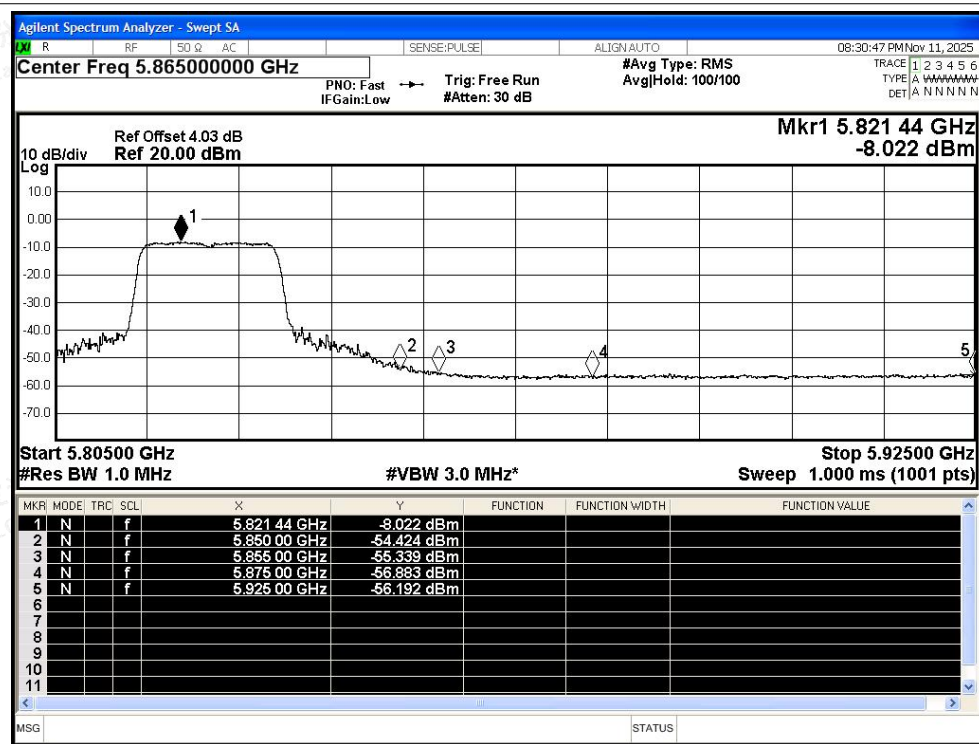

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5755MHz Ant1 Peak

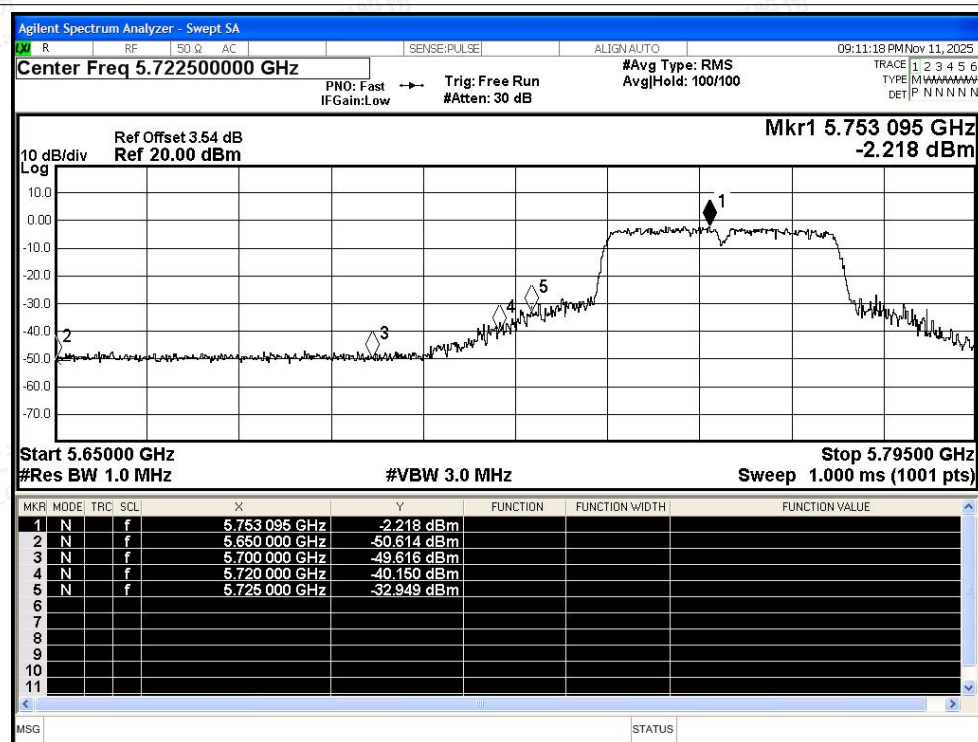

Restrict Band NVNT n40 5755MHz Ant1 Average

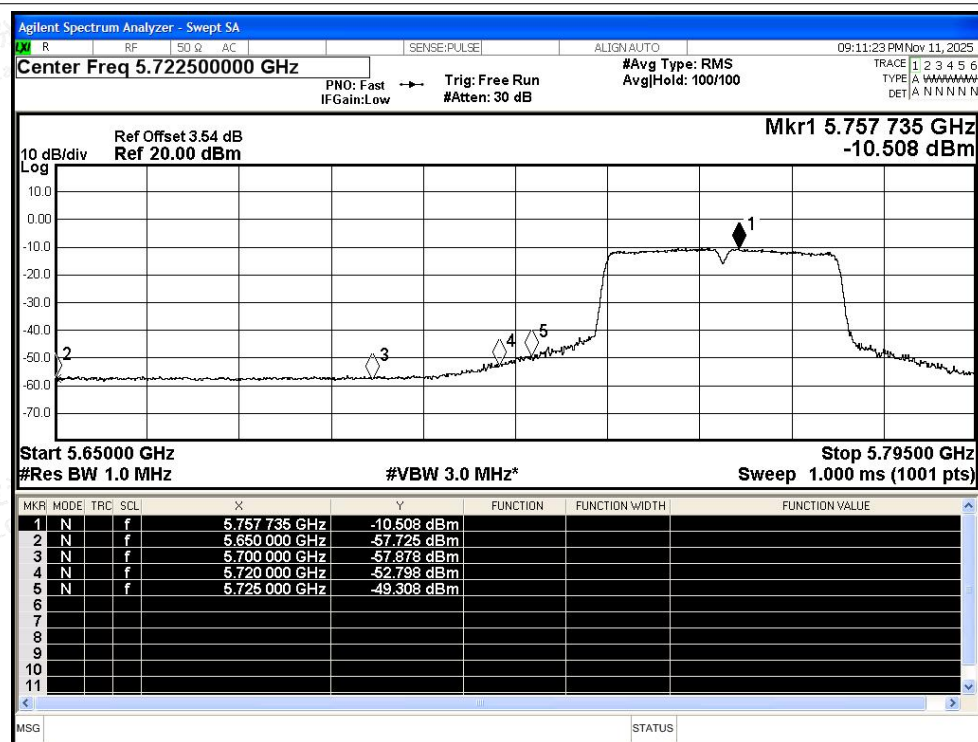

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity