



Restrict Band

Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5260	Ant2	4500	-50.75	2	46.51	Peak	68.2	Pass
NVNT	a	5260	Ant2	4500	-59.04	2	38.22	Average	54	Pass
NVNT	a	5260	Ant2	5057.7	-47.79	2	49.47	Peak	68.2	Pass
NVNT	a	5260	Ant2	5046	-56.88	2	40.38	Average	54	Pass
NVNT	a	5260	Ant2	5150	-52.05	2	45.21	Peak	68.2	Pass
NVNT	a	5260	Ant2	5150	-57.14	2	40.12	Average	54	Pass
NVNT	a	5320	Ant2	5350	-48.74	2	48.52	Peak	68.2	Pass
NVNT	a	5320	Ant2	5350	-56.54	2	40.72	Average	54	Pass
NVNT	a	5320	Ant2	5350.2	-46.35	2	50.91	Peak	68.2	Pass
NVNT	a	5320	Ant2	5350.2	-56.42	2	40.84	Average	54	Pass
NVNT	a	5320	Ant2	5460	-52.53	2	44.73	Peak	68.2	Pass
NVNT	a	5320	Ant2	5460	-58.13	2	39.13	Average	54	Pass
NVNT	n20	5260	Ant2	4500	-51.53	2	45.73	Peak	68.2	Pass
NVNT	n20	5260	Ant2	4500	-59.05	2	38.21	Average	54	Pass
NVNT	n20	5260	Ant2	5045.22	-47.16	2	50.10	Peak	68.2	Pass
NVNT	n20	5260	Ant2	5055.36	-56.85	2	40.41	Average	54	Pass
NVNT	n20	5260	Ant2	5150	-50.59	2	46.67	Peak	68.2	Pass
NVNT	n20	5260	Ant2	5150	-57.27	2	39.99	Average	54	Pass
NVNT	n20	5320	Ant2	5350	-46.63	2	50.63	Peak	68.2	Pass
NVNT	n20	5320	Ant2	5350	-55.8	2	41.46	Average	54	Pass
NVNT	n20	5320	Ant2	5350.2	-43.16	2	54.10	Peak	68.2	Pass
NVNT	n20	5320	Ant2	5350	-55.8	2	41.46	Average	54	Pass
NVNT	n20	5320	Ant2	5460	-49.17	2	48.09	Peak	68.2	Pass
NVNT	n20	5320	Ant2	5460	-57.98	2	39.28	Average	54	Pass
NVNT	n40	5270	Ant2	4500	-51.99	2	45.27	Peak	68.2	Pass
NVNT	n40	5270	Ant2	4500	-59.26	2	38.00	Average	54	Pass
NVNT	n40	5270	Ant2	5002.2	-46.43	2	50.83	Peak	68.2	Pass
NVNT	n40	5270	Ant2	4807.8	-56.67	2	40.59	Average	54	Pass
NVNT	n40	5270	Ant2	5150	-50.74	2	46.52	Peak	68.2	Pass
NVNT	n40	5270	Ant2	5150	-57.64	2	39.62	Average	54	Pass
NVNT	n40	5310	Ant2	5350	-45.91	2	51.35	Peak	68.2	Pass
NVNT	n40	5310	Ant2	5350	-56.32	2	40.94	Average	54	Pass
NVNT	n40	5310	Ant2	5353.2	-44.81	2	52.45	Peak	68.2	Pass
NVNT	n40	5310	Ant2	5350	-56.32	2	40.94	Average	54	Pass
NVNT	n40	5310	Ant2	5460	-50.58	2	46.68	Peak	68.2	Pass
NVNT	n40	5310	Ant2	5460	-57.8	2	39.46	Average	54	Pass
NVNT	ac20	5260	Ant2	4500	-51.92	2	45.34	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5260	Ant2	4500	-59.1	2	38.16	Average	54	Pass
NVNT	ac20	5260	Ant2	5056.14	-46.32	2	50.94	Peak	68.2	Pass
NVNT	ac20	5260	Ant2	5056.92	-56.86	2	40.40	Average	54	Pass
NVNT	ac20	5260	Ant2	5150	-50.49	2	46.77	Peak	68.2	Pass
NVNT	ac20	5260	Ant2	5150	-57.21	2	40.05	Average	54	Pass
NVNT	ac20	5320	Ant2	5350	-45.18	2	52.08	Peak	68.2	Pass
NVNT	ac20	5320	Ant2	5350	-54.28	2	42.98	Average	54	Pass
NVNT	ac20	5320	Ant2	5350.4	-40.74	2	56.52	Peak	68.2	Pass
NVNT	ac20	5320	Ant2	5350	-54.28	2	42.98	Average	54	Pass
NVNT	ac20	5320	Ant2	5460	-51.66	2	45.60	Peak	68.2	Pass
NVNT	ac20	5320	Ant2	5460	-57.98	2	39.28	Average	54	Pass
NVNT	ac40	5270	Ant2	4500	-52.91	2	44.35	Peak	68.2	Pass
NVNT	ac40	5270	Ant2	4500	-59.38	2	37.88	Average	54	Pass
NVNT	ac40	5270	Ant2	5125.32	-47.58	2	49.68	Peak	68.2	Pass
NVNT	ac40	5270	Ant2	4806.99	-56.45	2	40.81	Average	54	Pass
NVNT	ac40	5270	Ant2	5150	-49.55	2	47.71	Peak	68.2	Pass
NVNT	ac40	5270	Ant2	5150	-57.49	2	39.77	Average	54	Pass
NVNT	ac40	5310	Ant2	5350	-45.5	2	51.76	Peak	68.2	Pass
NVNT	ac40	5310	Ant2	5350	-56.43	2	40.83	Average	54	Pass
NVNT	ac40	5310	Ant2	5350.6	-44.53	2	52.73	Peak	68.2	Pass
NVNT	ac40	5310	Ant2	5350.6	-56.28	2	40.98	Average	54	Pass
NVNT	ac40	5310	Ant2	5460	-51.77	2	45.49	Peak	68.2	Pass
NVNT	ac40	5310	Ant2	5460	-57.85	2	39.41	Average	54	Pass
NVNT	ac80	5290	Ant2	5350	-49.42	2	47.84	Peak	68.2	Pass
NVNT	ac80	5290	Ant2	5350	-56.07	2	41.19	Average	54	Pass
NVNT	ac80	5290	Ant2	5350.25	-44.14	2	53.12	Peak	68.2	Pass
NVNT	ac80	5290	Ant2	5350.75	-56.05	2	41.21	Average	54	Pass
NVNT	ac80	5290	Ant2	5460	-50.88	2	46.38	Peak	68.2	Pass
NVNT	ac80	5290	Ant2	5460	-57.58	2	39.68	Average	54	Pass
NVNT	ac80	5290	Ant2	4500	-51.48	2	45.78	Peak	68.2	Pass
NVNT	ac80	5290	Ant2	4500	-59.33	2	37.93	Average	54	Pass
NVNT	ac80	5290	Ant2	5103.78	-47.64	2	49.62	Peak	68.2	Pass
NVNT	ac80	5290	Ant2	5021.13	-56.68	2	40.58	Average	54	Pass
NVNT	ac80	5290	Ant2	5150	-50.3	2	46.96	Peak	68.2	Pass
NVNT	ac80	5290	Ant2	5150	-57.72	2	39.54	Average	54	Pass
NVNT	ax20	5260	Ant2	4500	-52.2	2	45.06	Peak	68.2	Pass
NVNT	ax20	5260	Ant2	4500	-59.13	2	38.13	Average	54	Pass
NVNT	ax20	5260	Ant2	5014.8	-47.61	2	49.65	Peak	68.2	Pass
NVNT	ax20	5260	Ant2	5048.34	-56.87	2	40.39	Average	54	Pass
NVNT	ax20	5260	Ant2	5150	-49.08	2	48.18	Peak	68.2	Pass
NVNT	ax20	5260	Ant2	5150	-57.24	2	40.02	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax20	5320	Ant2	5350	-40.11	2	57.15	Peak	68.2	Pass
NVNT	ax20	5320	Ant2	5350	-54.48	2	42.78	Average	54	Pass
NVNT	ax20	5320	Ant2	5351.6	-37.74	2	59.52	Peak	68.2	Pass
NVNT	ax20	5320	Ant2	5350	-54.48	2	42.78	Average	54	Pass
NVNT	ax20	5320	Ant2	5460	-50.85	2	46.41	Peak	68.2	Pass
NVNT	ax20	5320	Ant2	5460	-58.03	2	39.23	Average	54	Pass
NVNT	ax40	5270	Ant2	4500	-52.23	2	45.03	Peak	68.2	Pass
NVNT	ax40	5270	Ant2	4500	-59.39	2	37.87	Average	54	Pass
NVNT	ax40	5270	Ant2	5088.06	-47.78	2	49.48	Peak	68.2	Pass
NVNT	ax40	5270	Ant2	4806.99	-56.38	2	40.88	Average	54	Pass
NVNT	ax40	5270	Ant2	5150	-49.56	2	47.70	Peak	68.2	Pass
NVNT	ax40	5270	Ant2	5150	-57.47	2	39.79	Average	54	Pass
NVNT	ax40	5310	Ant2	5350	-48.09	2	49.17	Peak	68.2	Pass
NVNT	ax40	5310	Ant2	5350	-56.03	2	41.23	Average	54	Pass
NVNT	ax40	5310	Ant2	5354.8	-45.79	2	51.47	Peak	68.2	Pass
NVNT	ax40	5310	Ant2	5350	-56.03	2	41.23	Average	54	Pass
NVNT	ax40	5310	Ant2	5460	-51.2	2	46.06	Peak	68.2	Pass
NVNT	ax40	5310	Ant2	5460	-57.93	2	39.33	Average	54	Pass
NVNT	ax80	5290	Ant2	5350	-45.63	2	51.63	Peak	68.2	Pass
NVNT	ax80	5290	Ant2	5350	-56.23	2	41.03	Average	54	Pass
NVNT	ax80	5290	Ant2	5350	-45.63	2	51.63	Peak	68.2	Pass
NVNT	ax80	5290	Ant2	5350.25	-56.07	2	41.19	Average	54	Pass
NVNT	ax80	5290	Ant2	5460	-51.41	2	45.85	Peak	68.2	Pass
NVNT	ax80	5290	Ant2	5460	-57.84	2	39.42	Average	54	Pass
NVNT	ax80	5290	Ant2	4500	-51.83	2	45.43	Peak	68.2	Pass
NVNT	ax80	5290	Ant2	4500	-59.44	2	37.82	Average	54	Pass
NVNT	ax80	5290	Ant2	4747.95	-47.25	2	50.01	Peak	68.2	Pass
NVNT	ax80	5290	Ant2	5057.67	-56.84	2	40.42	Average	54	Pass
NVNT	ax80	5290	Ant2	5150	-51.08	2	46.18	Peak	68.2	Pass
NVNT	ax80	5290	Ant2	5150	-57.63	2	39.63	Average	54	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

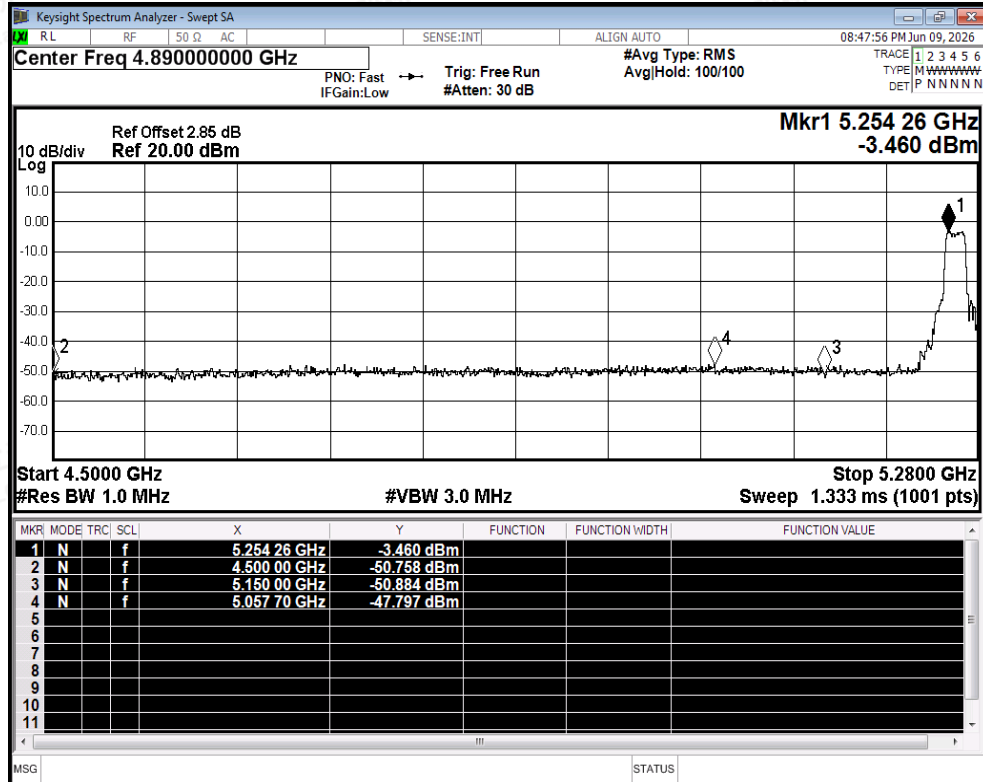

Restrict Band NVNT a 5260MHz Ant1 Peak

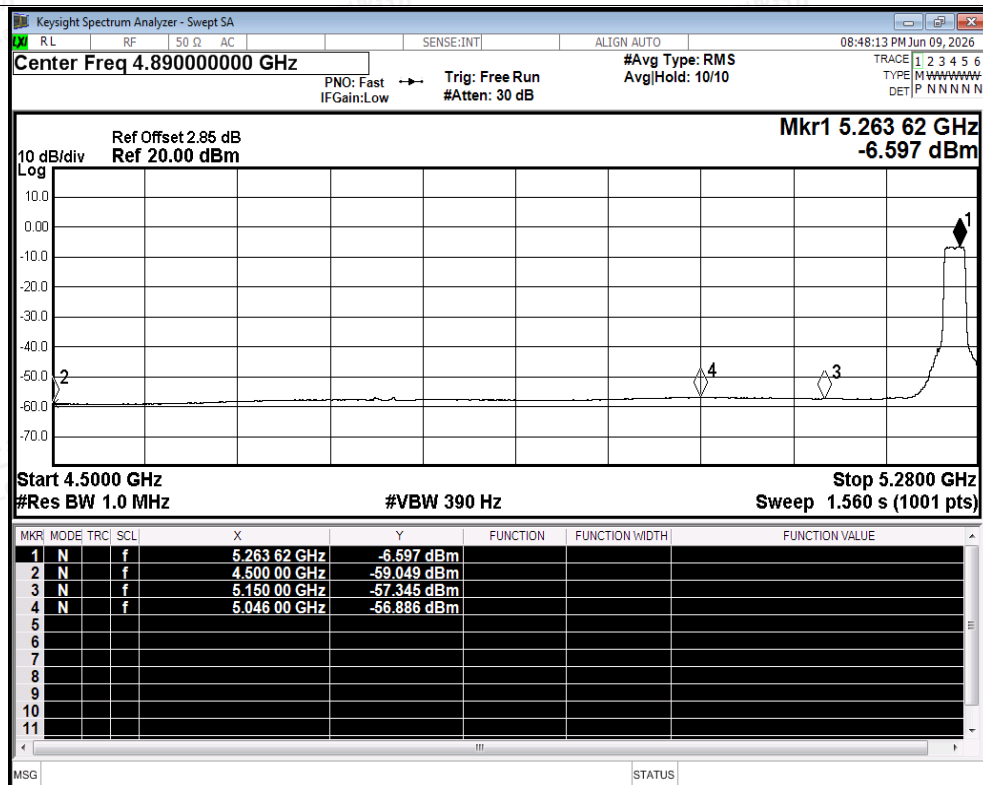

Restrict Band NVNT a 5260MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

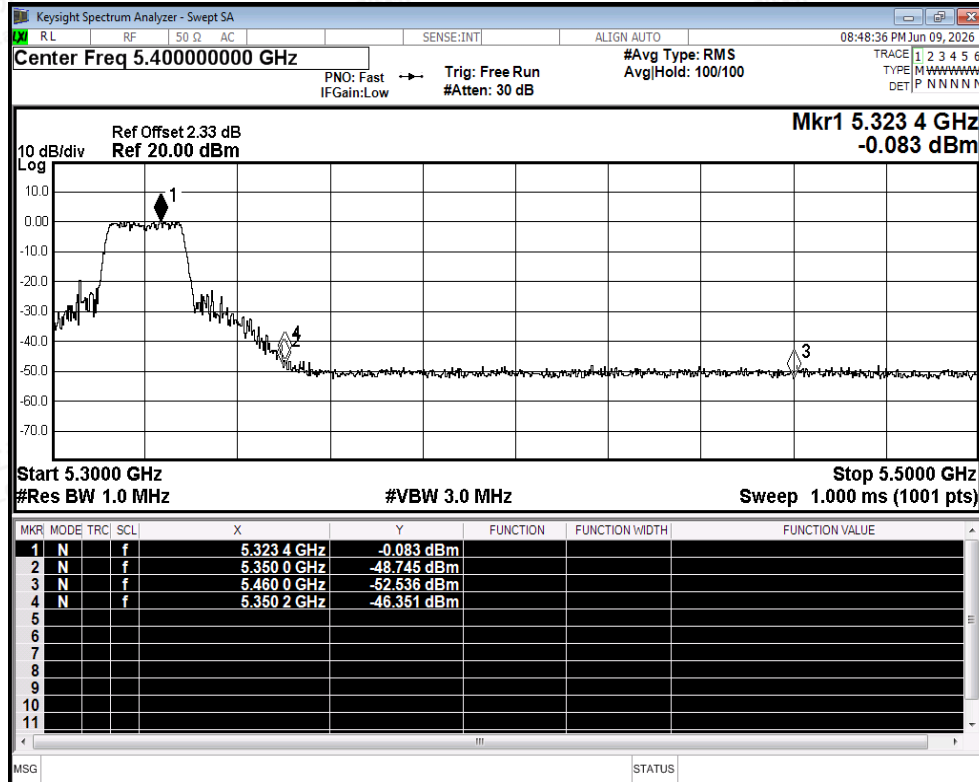

Restrict Band NVNT a 5320MHz Ant1 Peak

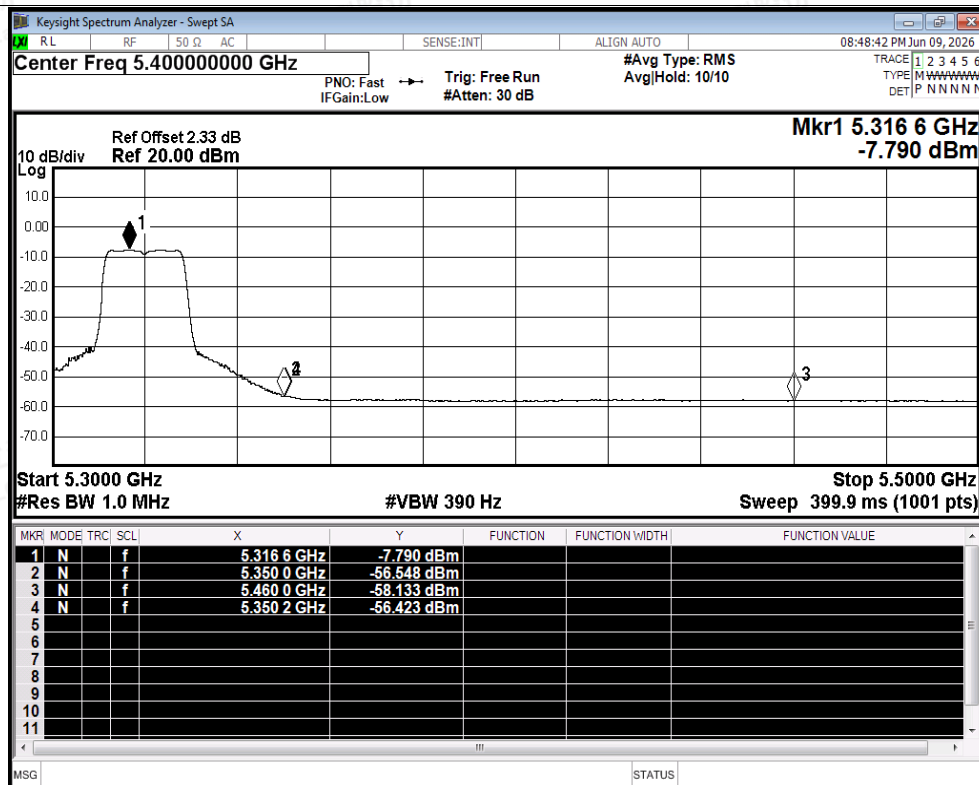

Restrict Band NVNT a 5320MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

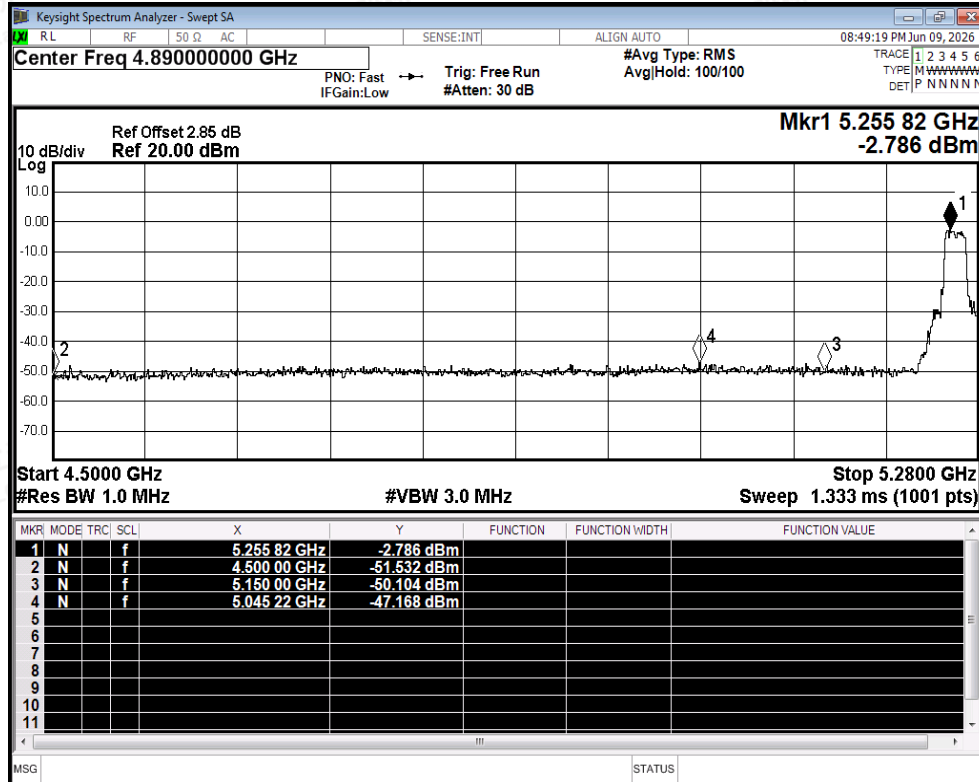

Restrict Band NVNT n20 5260MHz Ant1 Peak

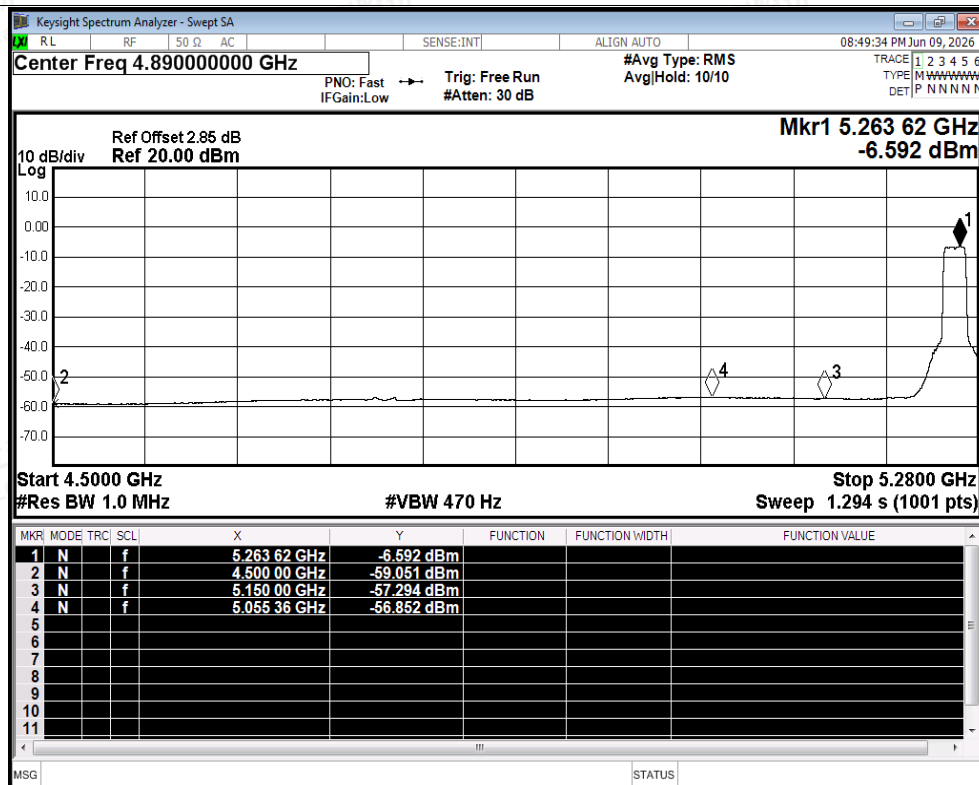

Restrict Band NVNT n20 5260MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

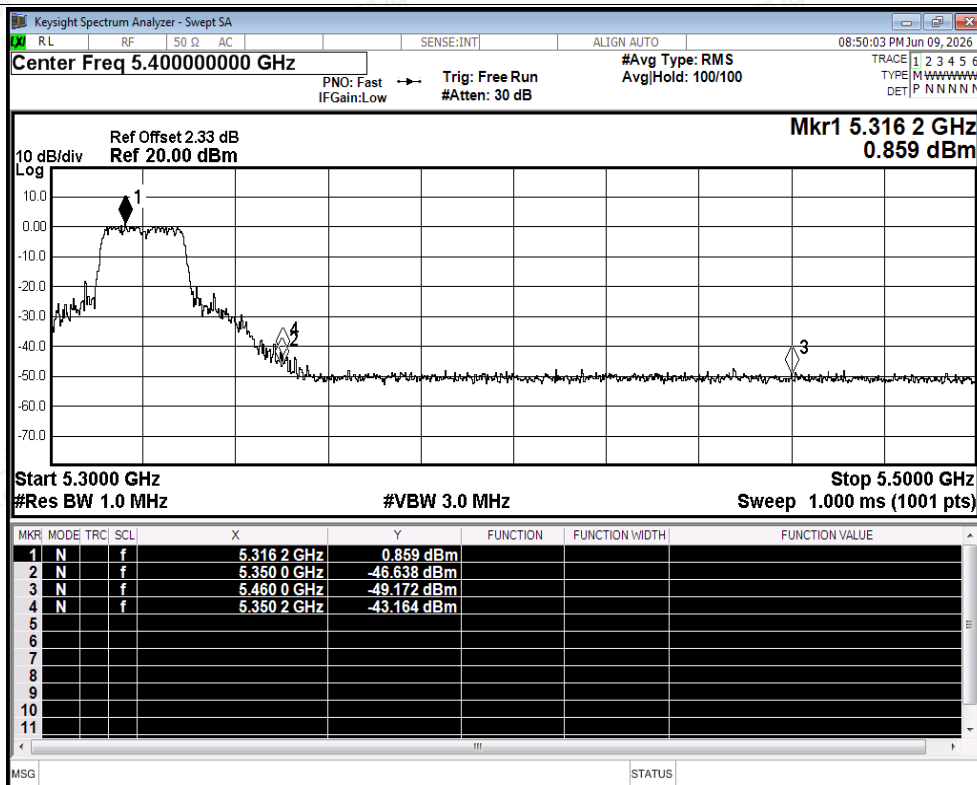

Restrict Band NVNT n20 5320MHz Ant1 Peak

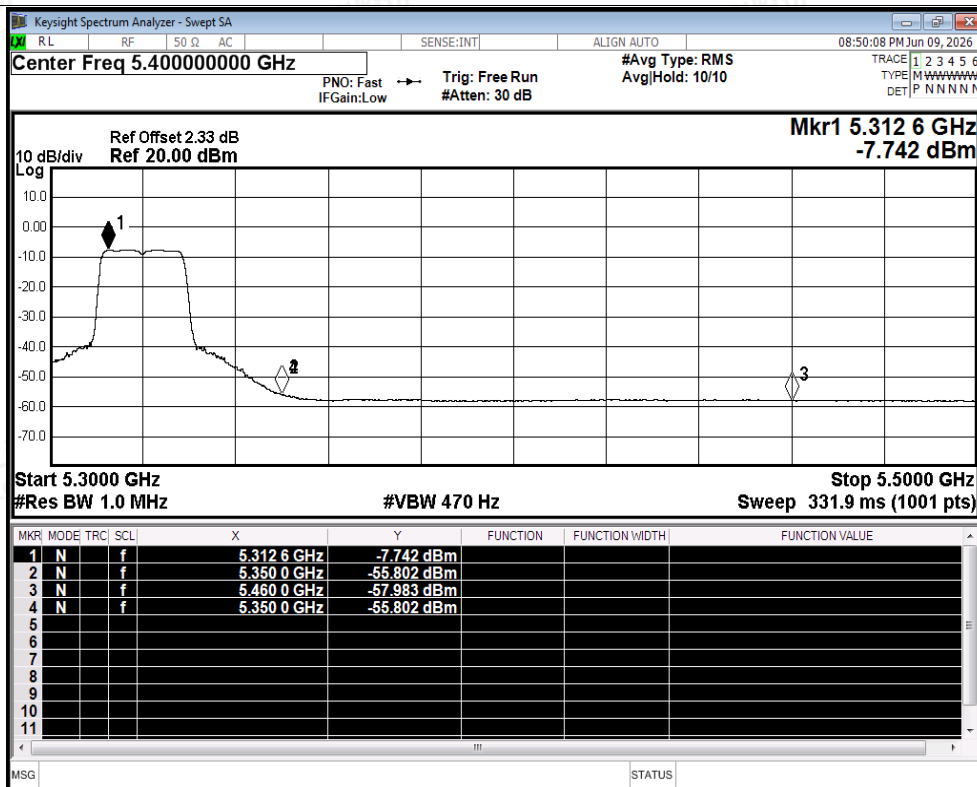

Restrict Band NVNT n20 5320MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

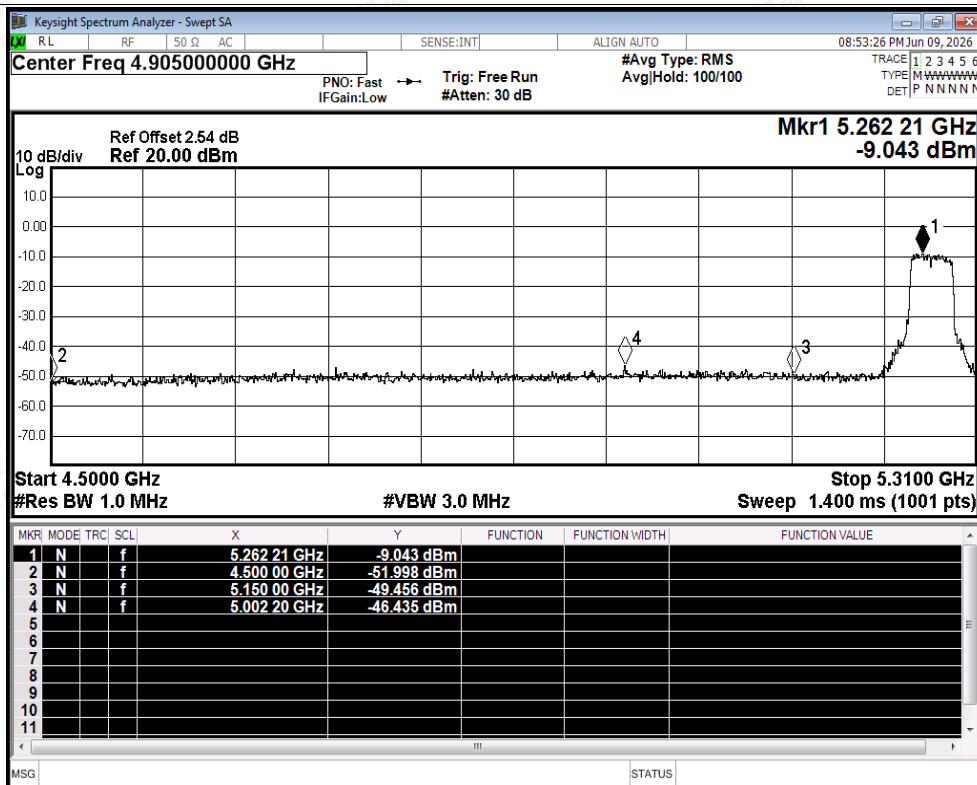

Restrict Band NVNT n40 5270MHz Ant1 Peak

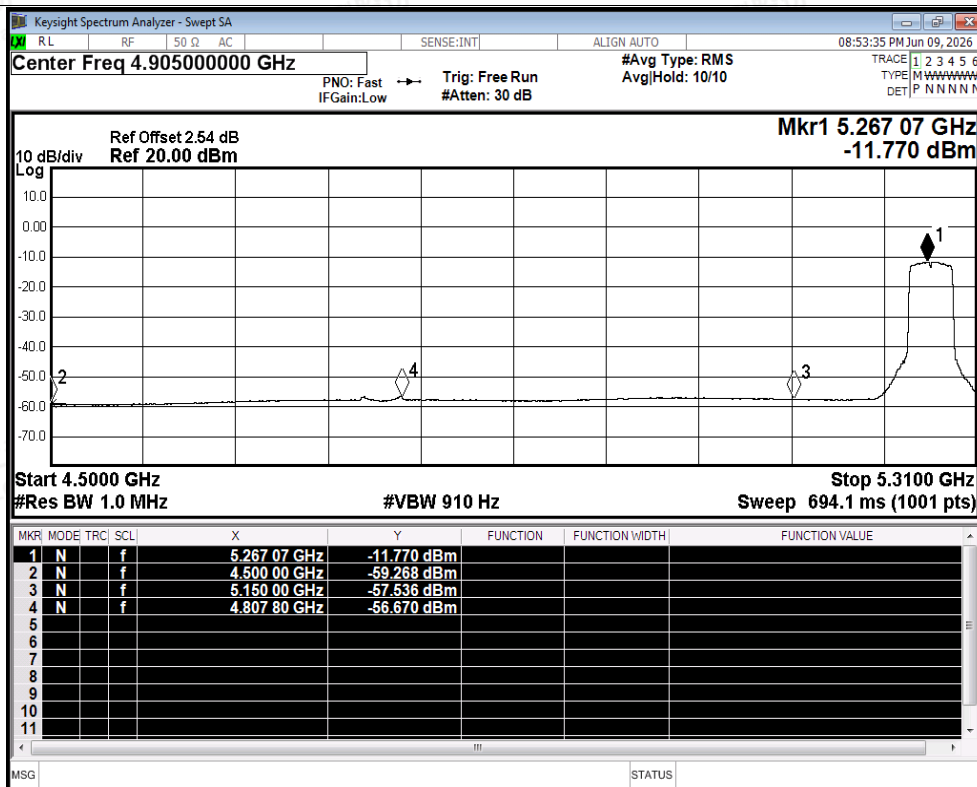

Restrict Band NVNT n40 5270MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

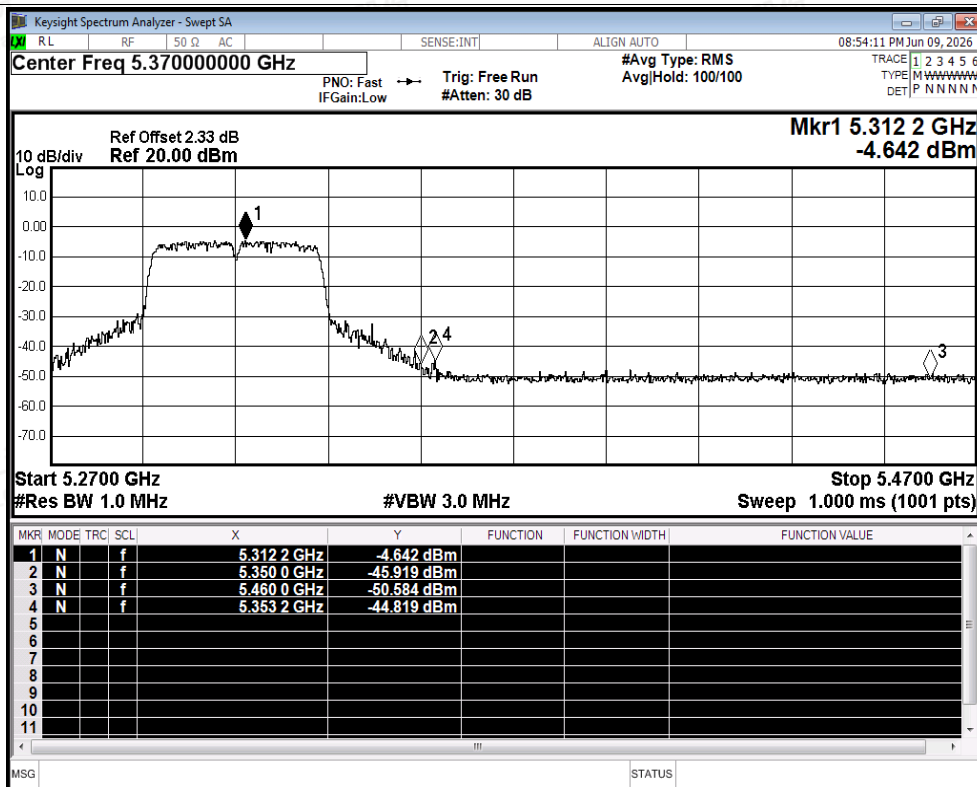

Restrict Band NVNT n40 5310MHz Ant1 Peak

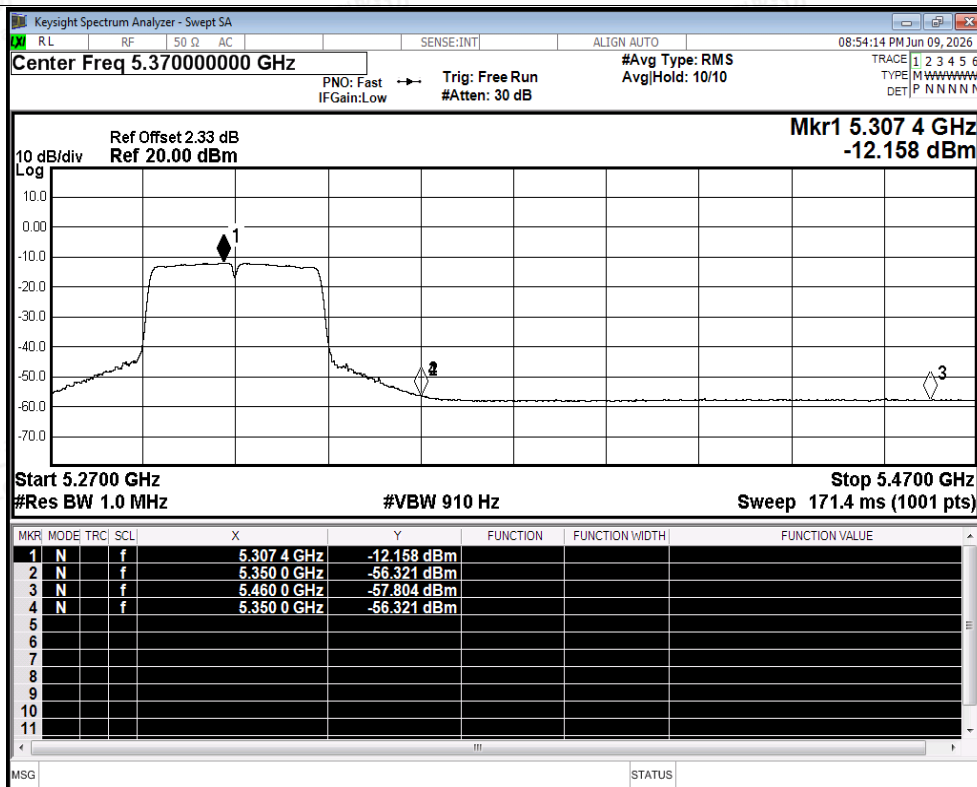

Restrict Band NVNT n40 5310MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

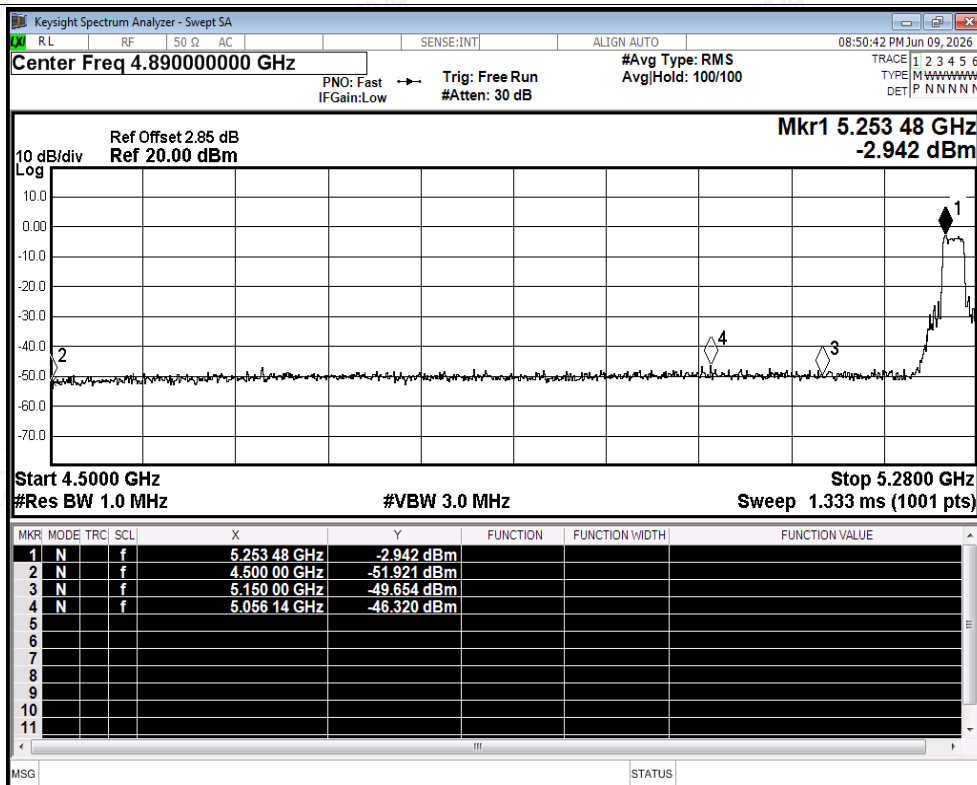

Restrict Band NVNT ac20 5260MHz Ant1 Peak

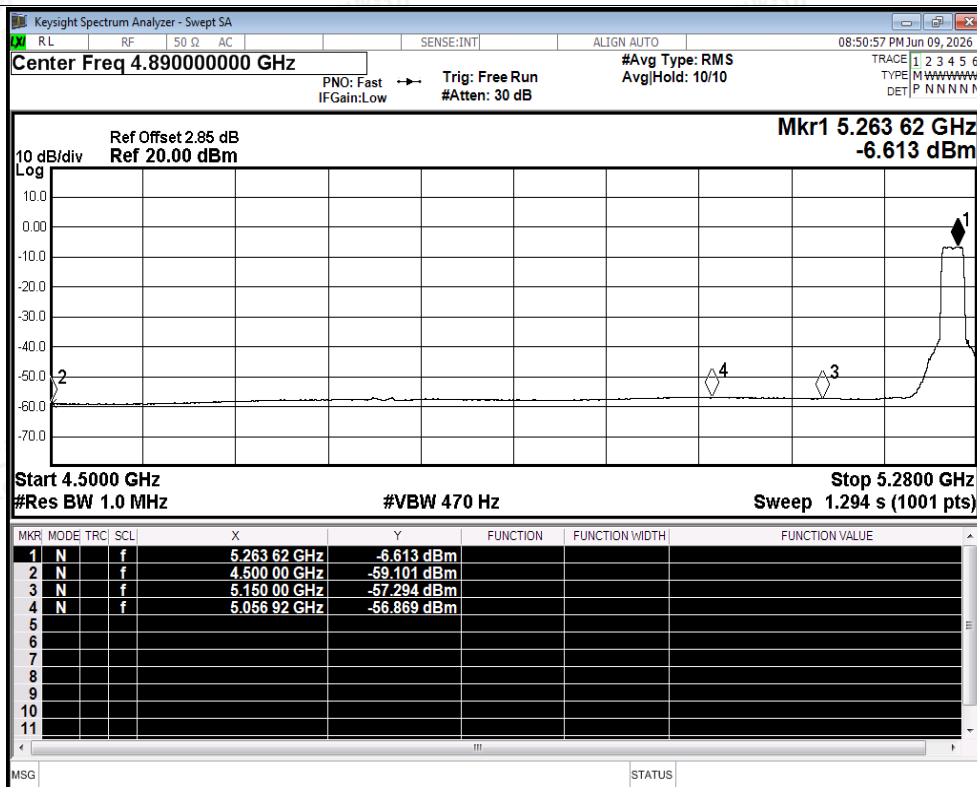

Restrict Band NVNT ac20 5260MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

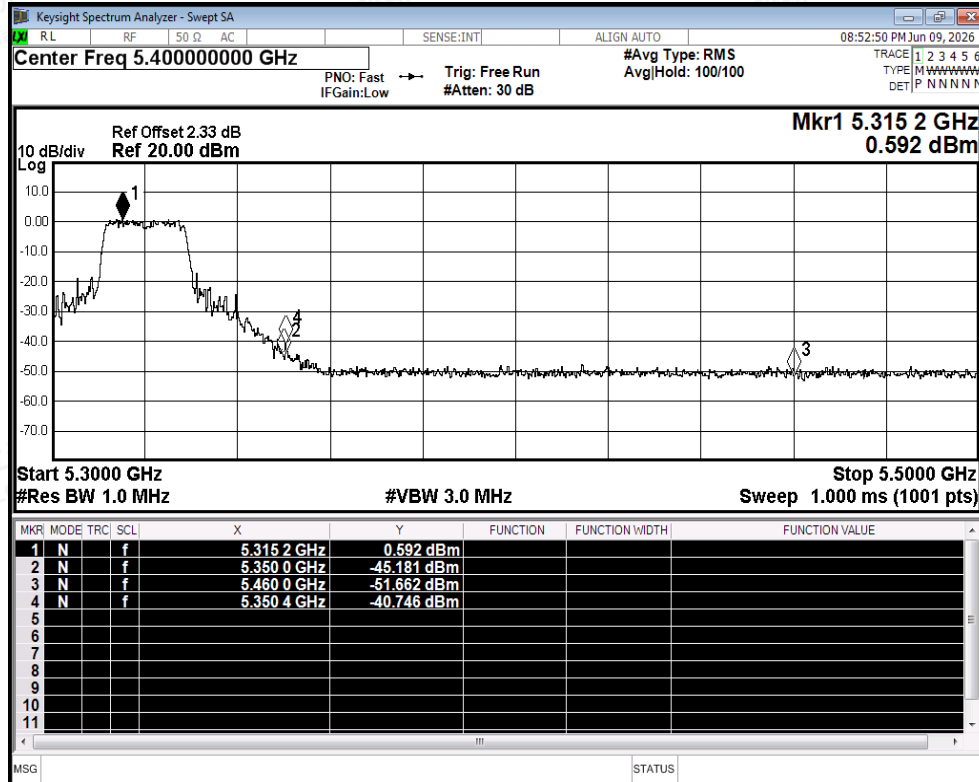

Restrict Band NVNT ac20 5320MHz Ant1 Peak

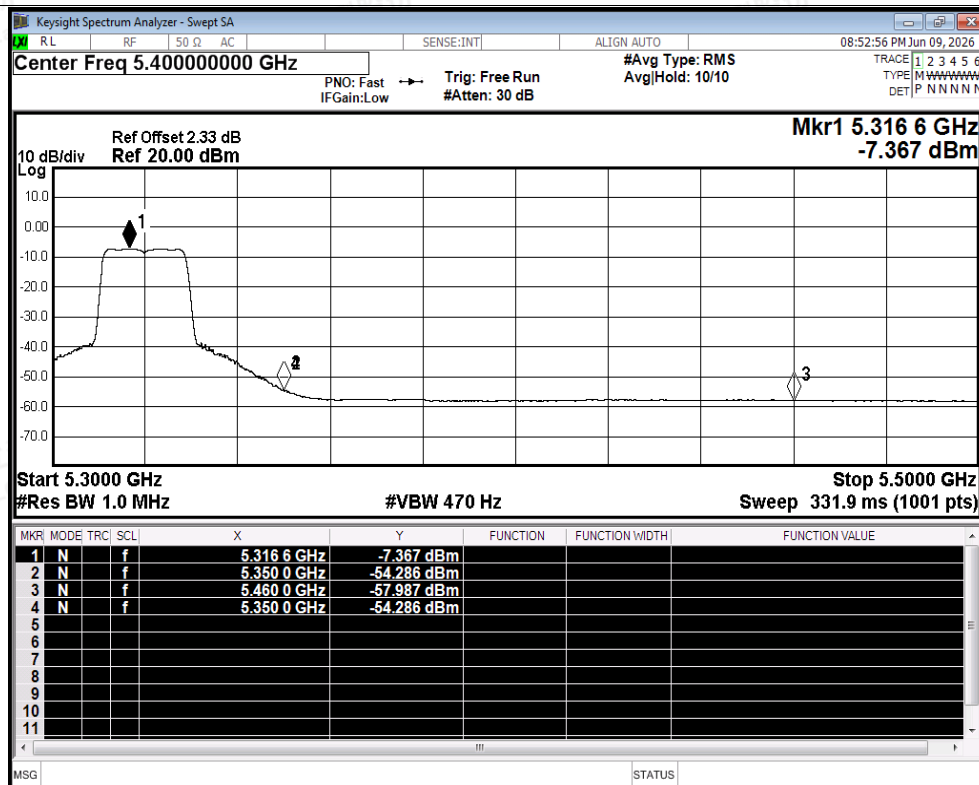

Restrict Band NVNT ac20 5320MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

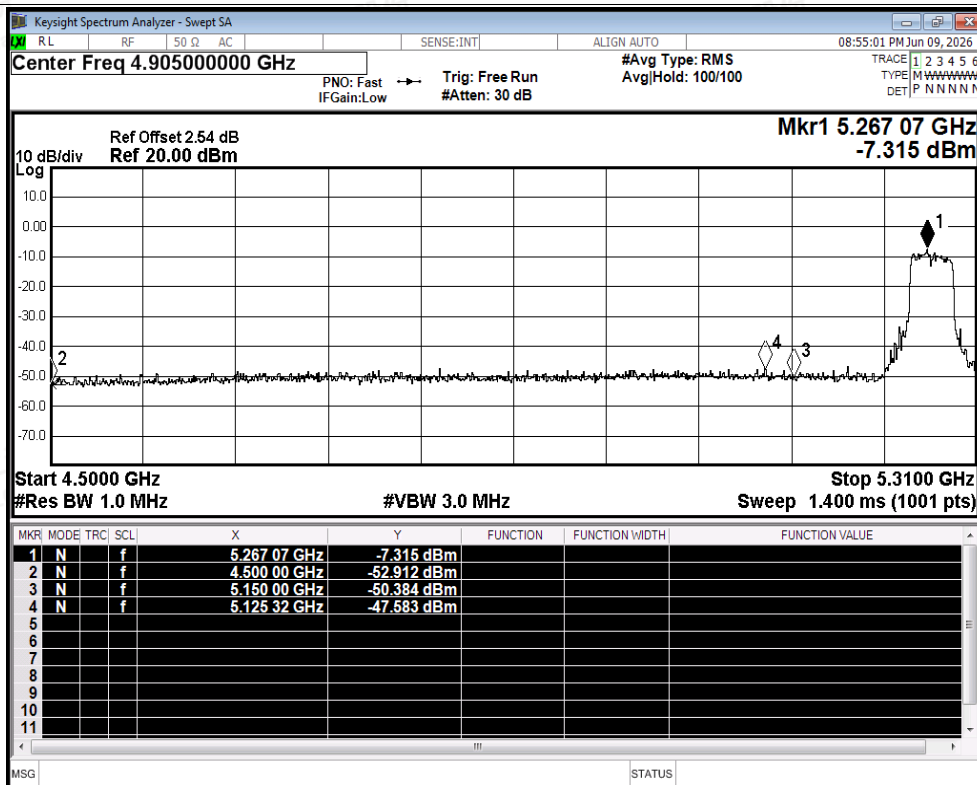

Restrict Band NVNT ac40 5270MHz Ant1 Peak

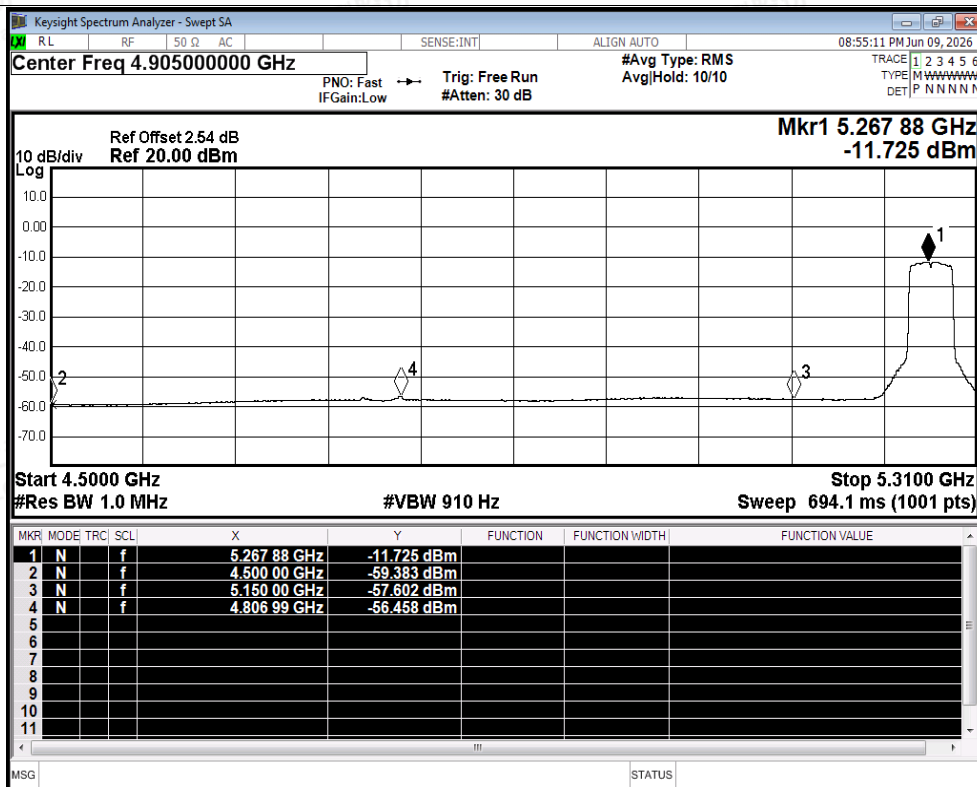

Restrict Band NVNT ac40 5270MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

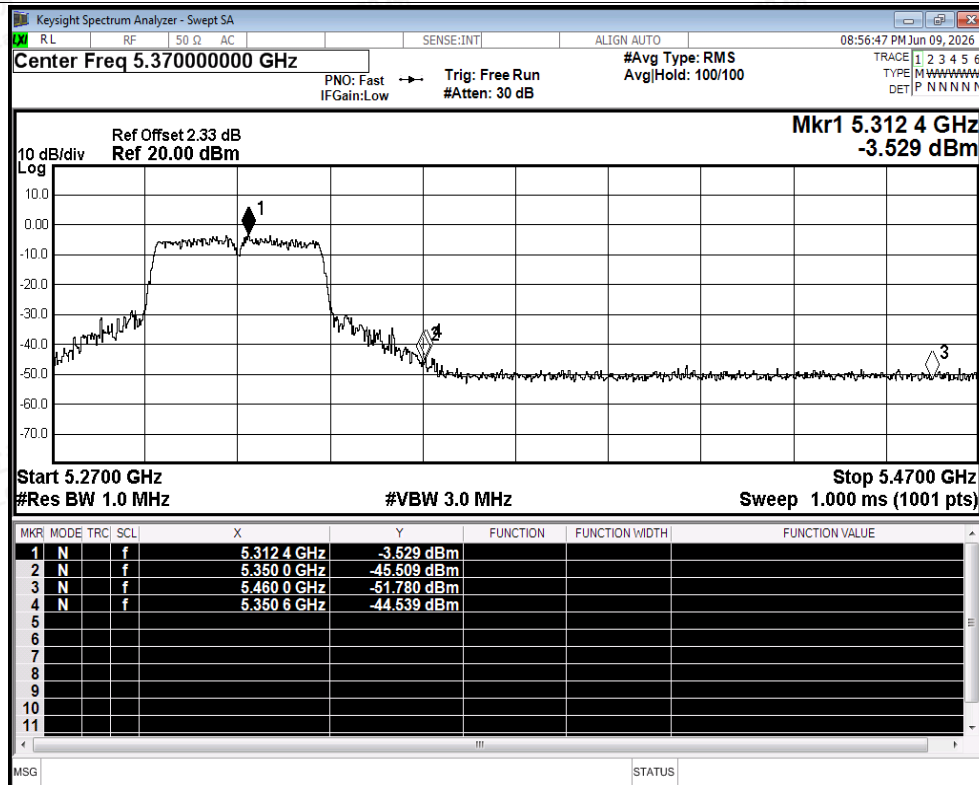

Restrict Band NVNT ac40 5310MHz Ant1 Peak

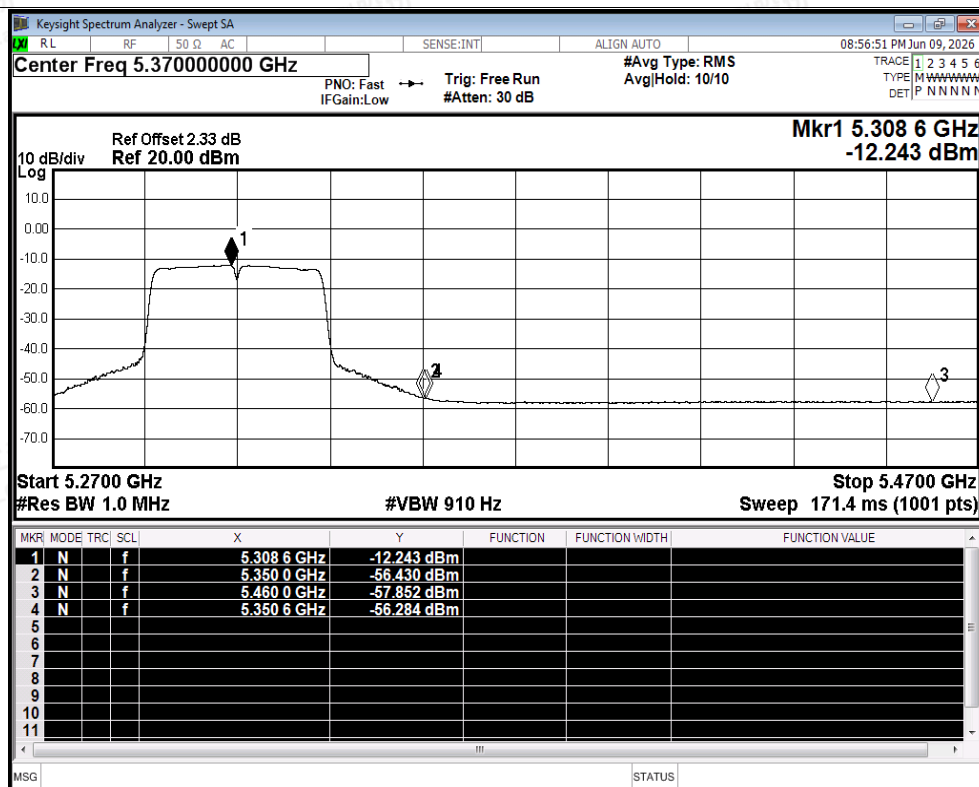

Restrict Band NVNT ac40 5310MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

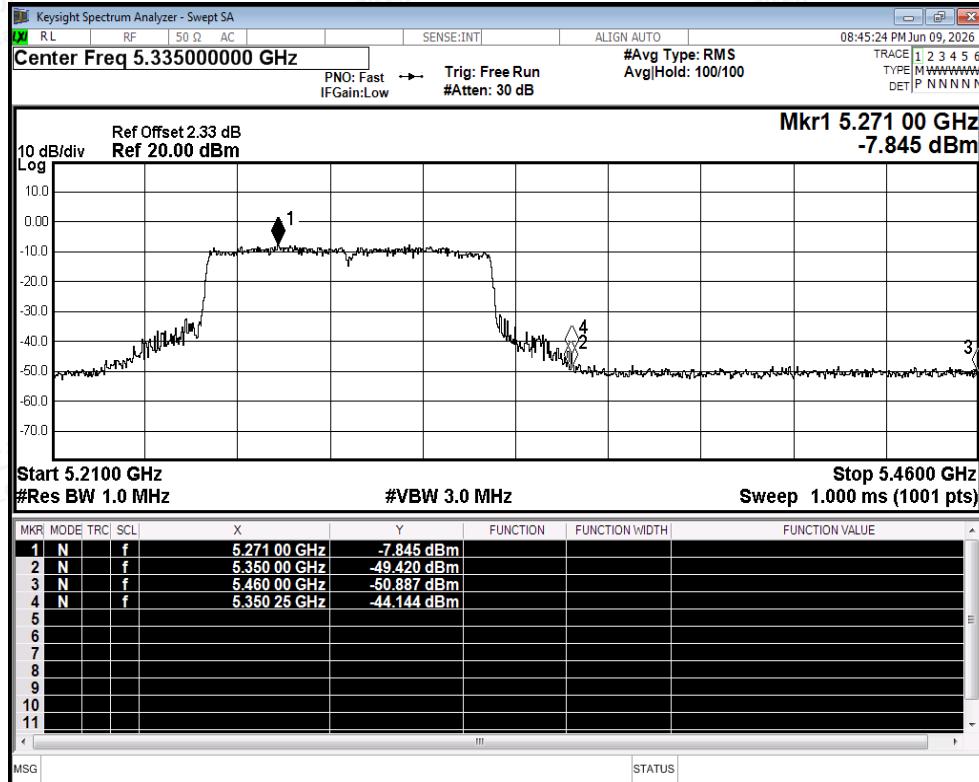

Restrict Band NVNT ac80 5290MHz Ant1 Peak

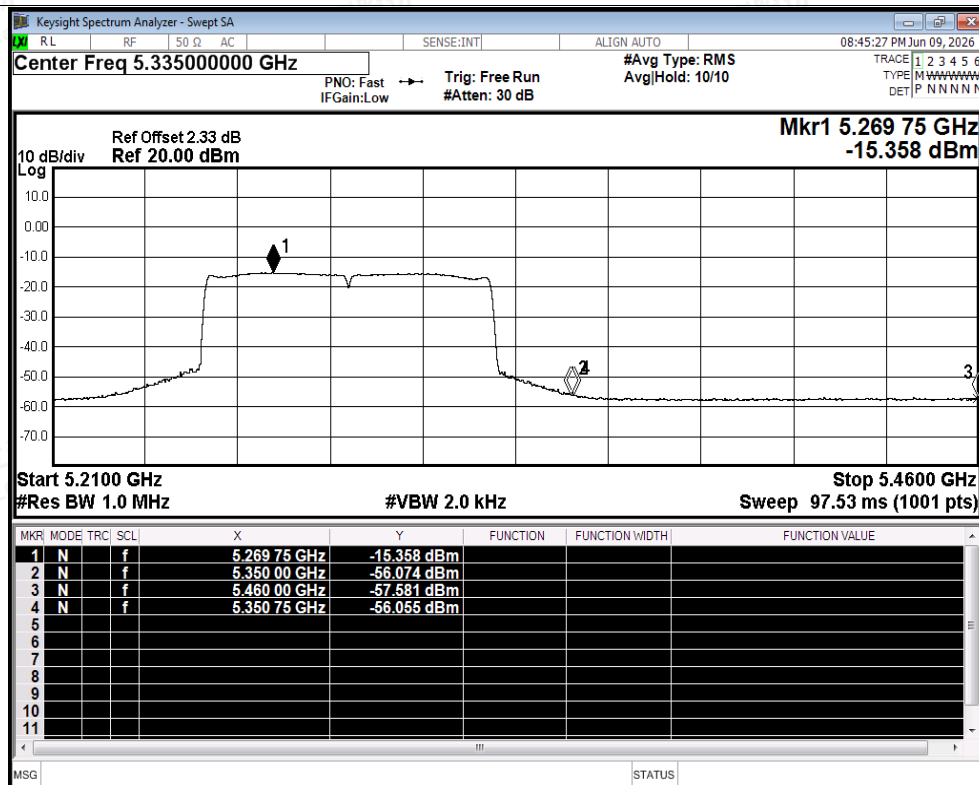

Restrict Band NVNT ac80 5290MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

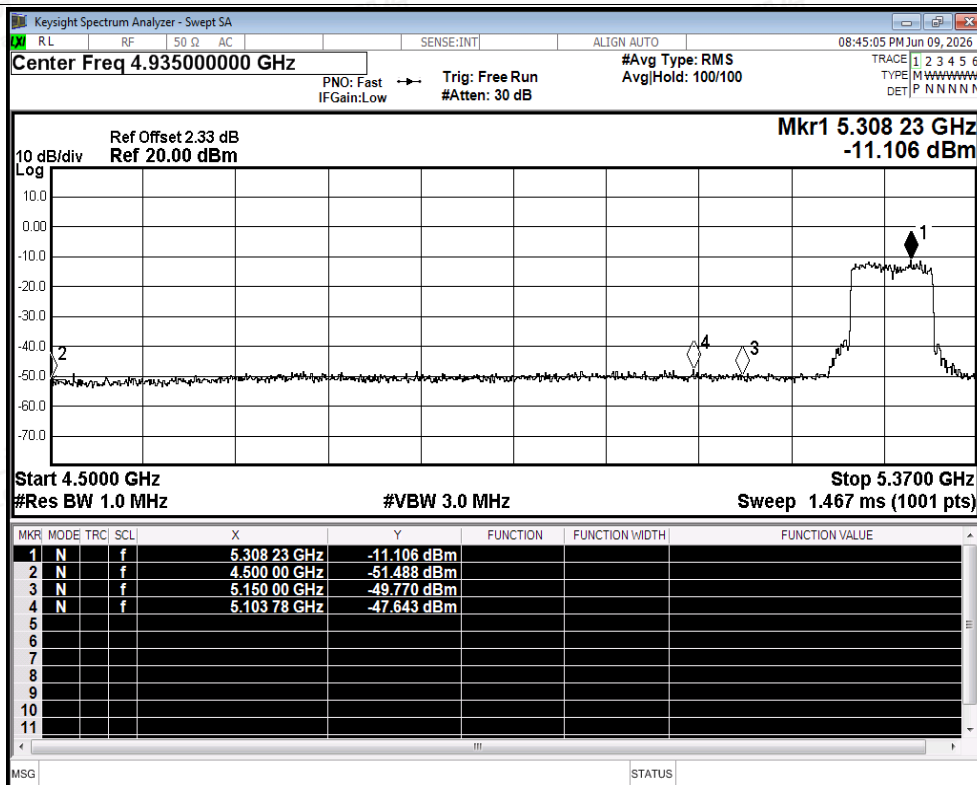

Restrict Band NVNT ac80 5290MHz Ant1 Peak

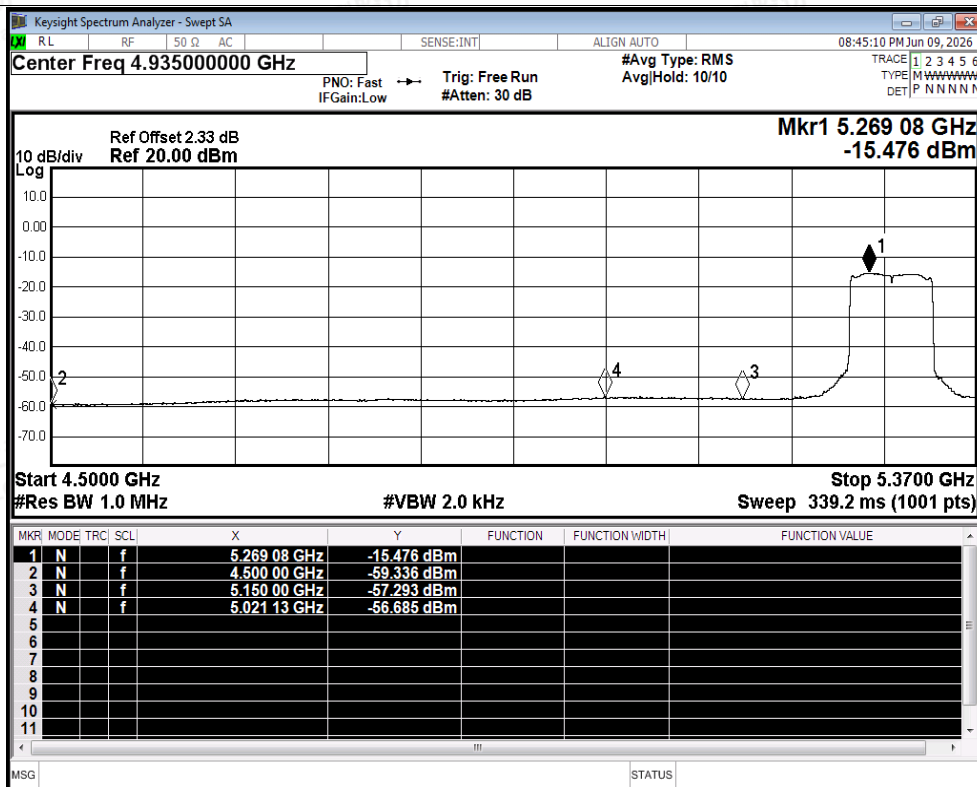

Restrict Band NVNT ac80 5290MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

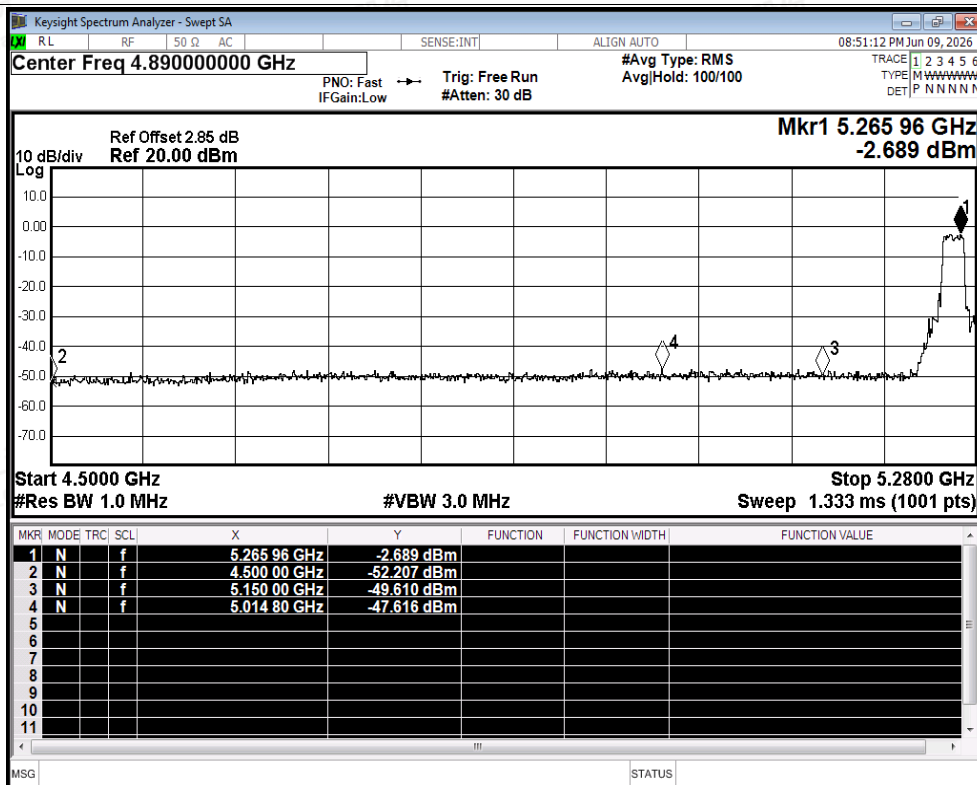

Restrict Band NVNT ax20 5260MHz Ant1 Peak

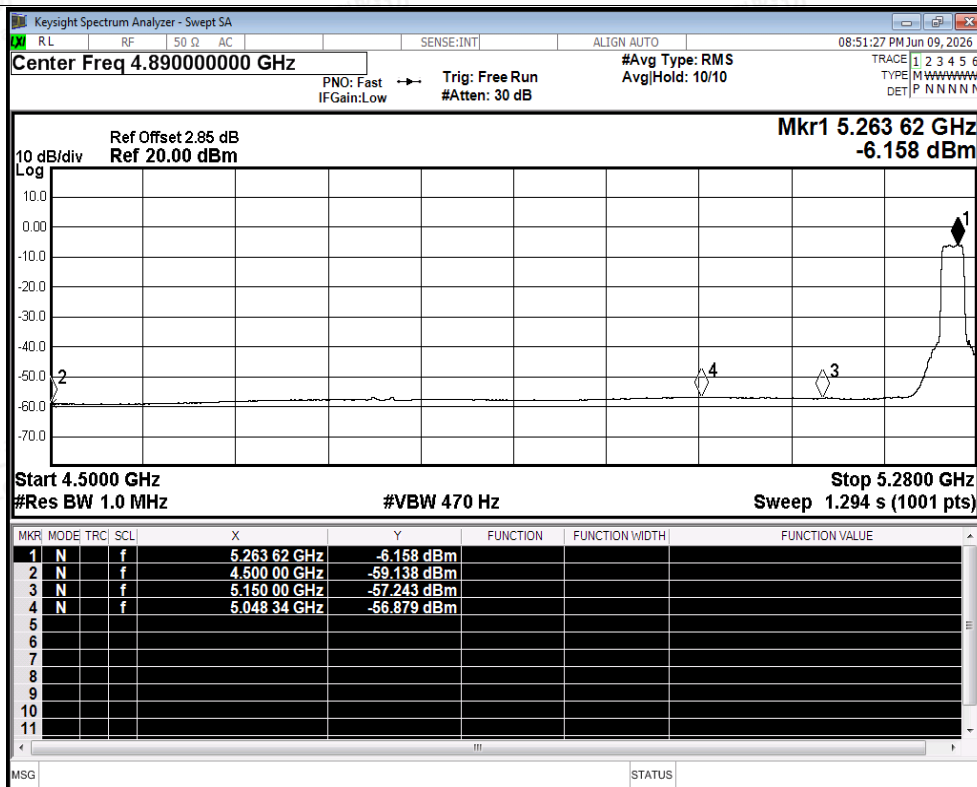

Restrict Band NVNT ax20 5260MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

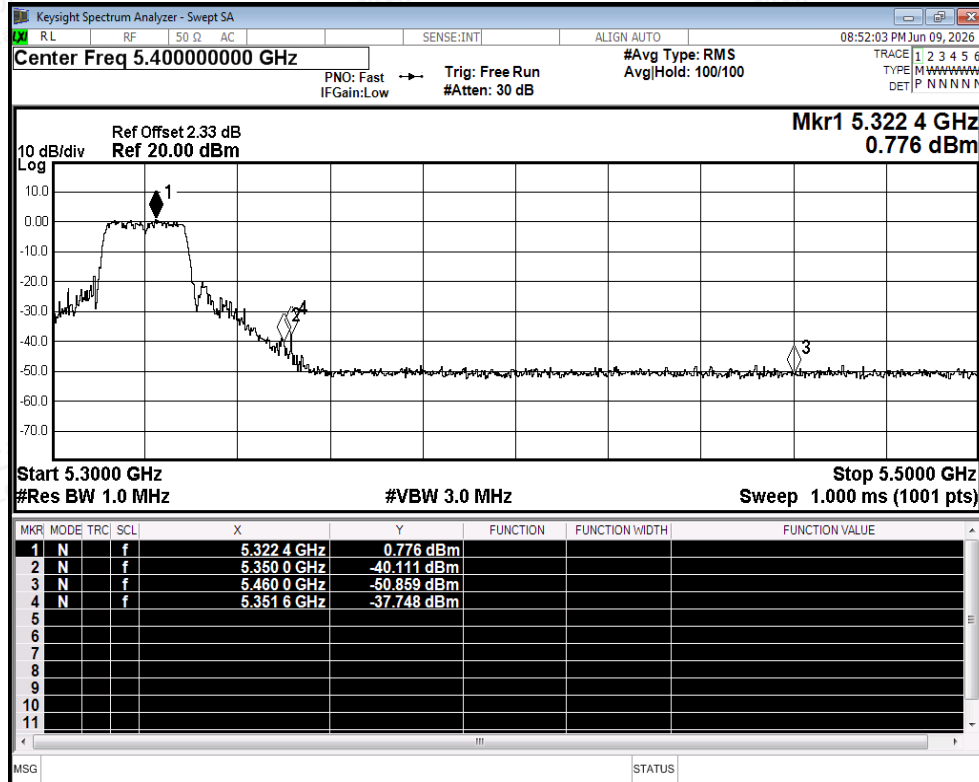

Restrict Band NVNT ax20 5320MHz Ant1 Peak

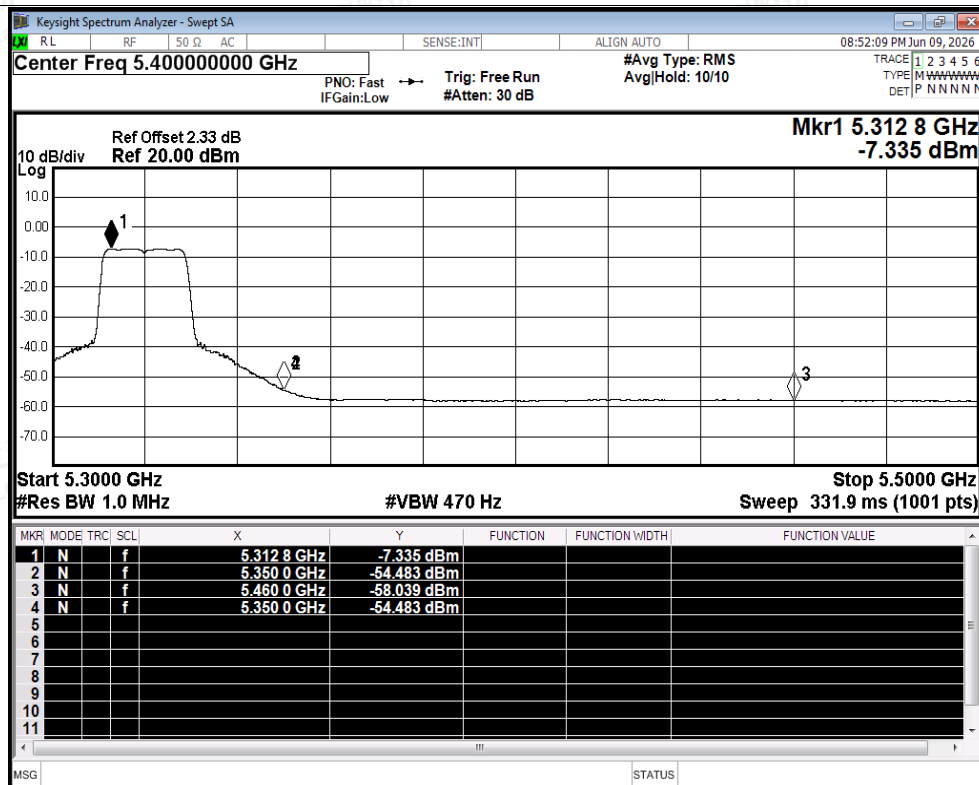

Restrict Band NVNT ax20 5320MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

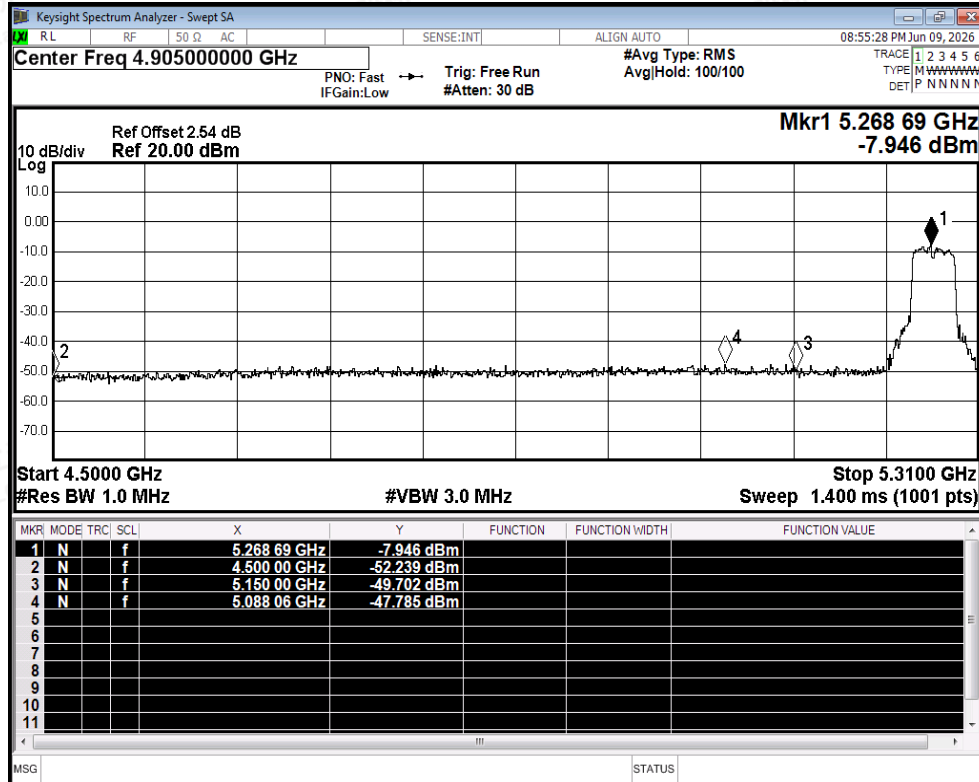

Restrict Band NVNT ax40 5270MHz Ant1 Peak

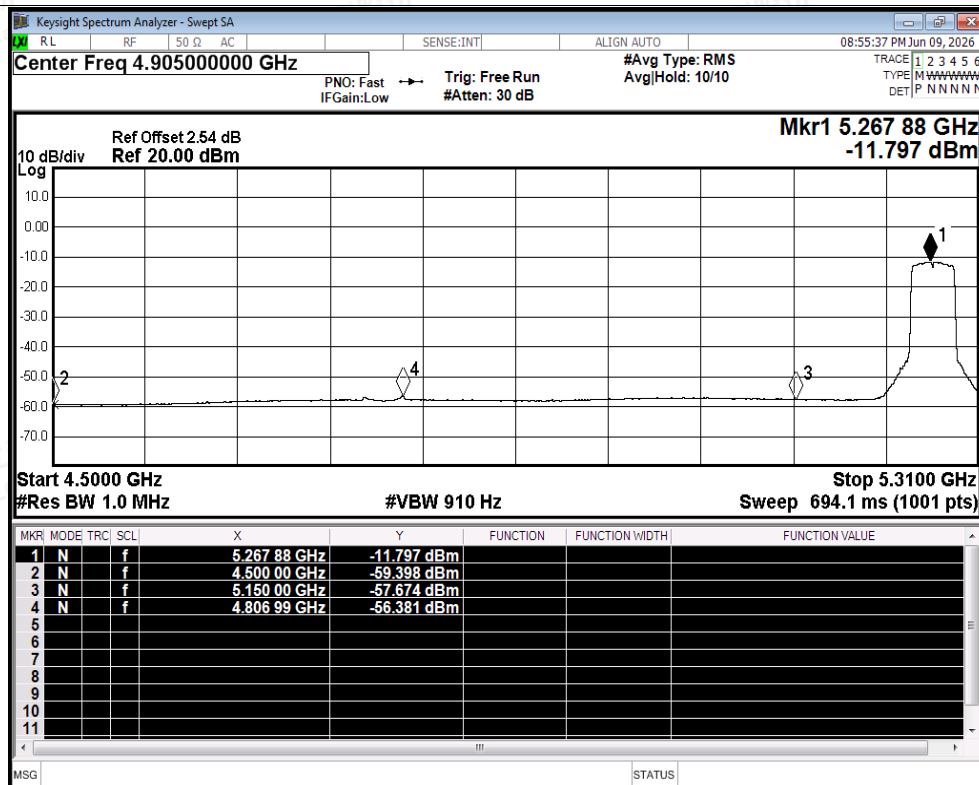

Restrict Band NVNT ax40 5270MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

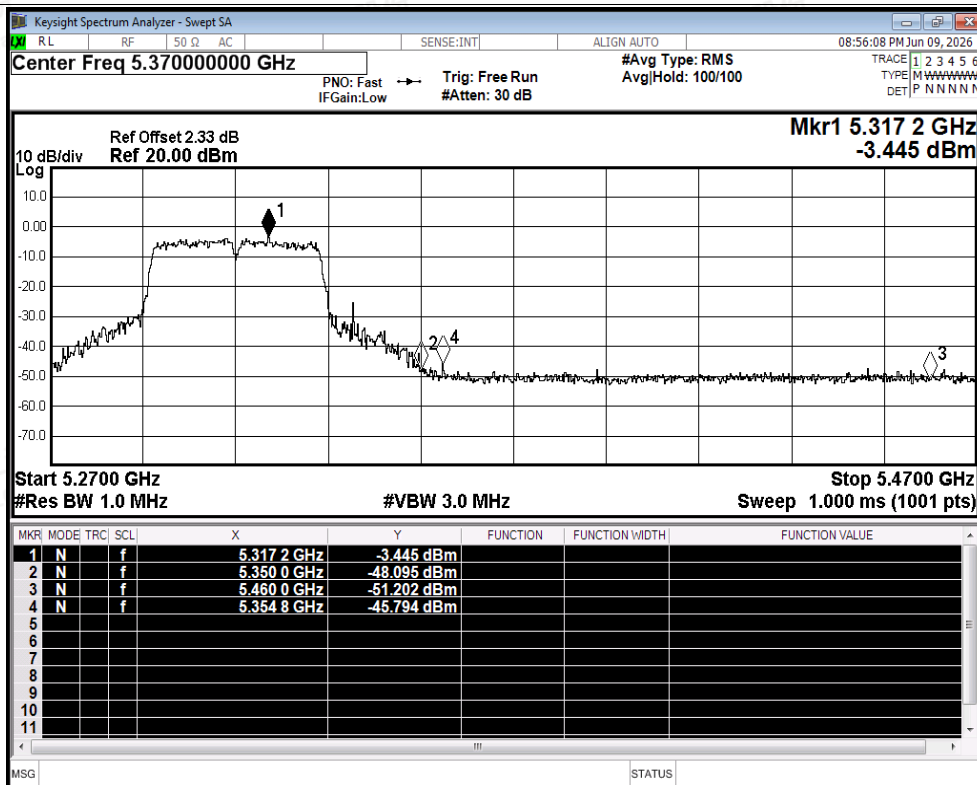

Restrict Band NVNT ax40 5310MHz Ant1 Peak

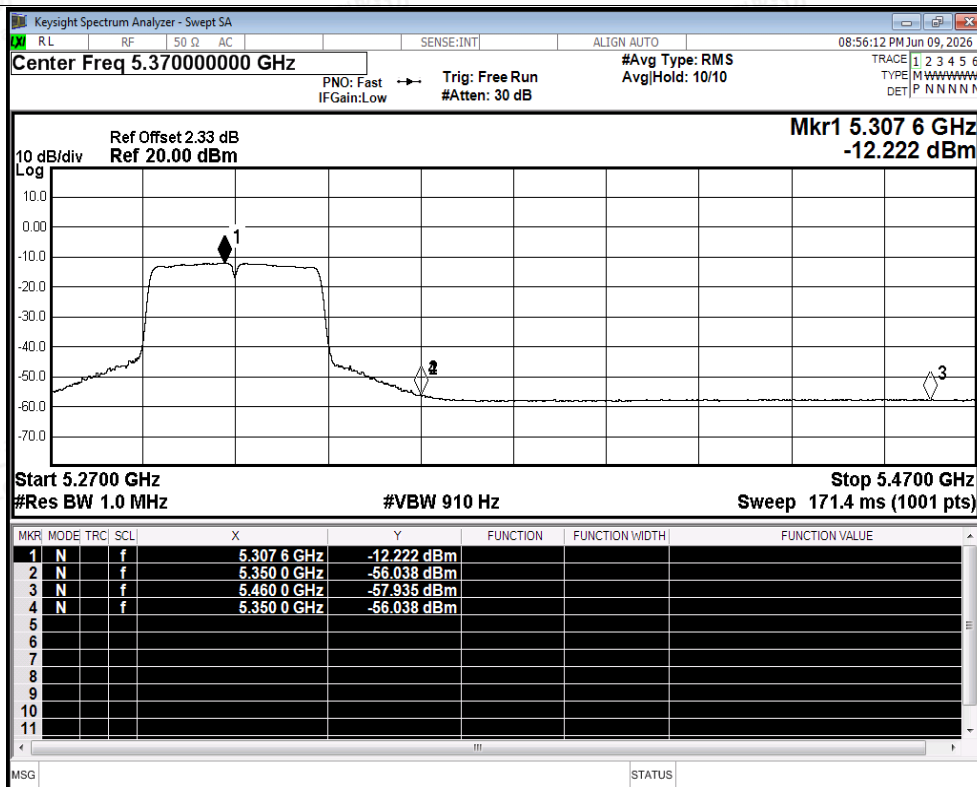

Restrict Band NVNT ax40 5310MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

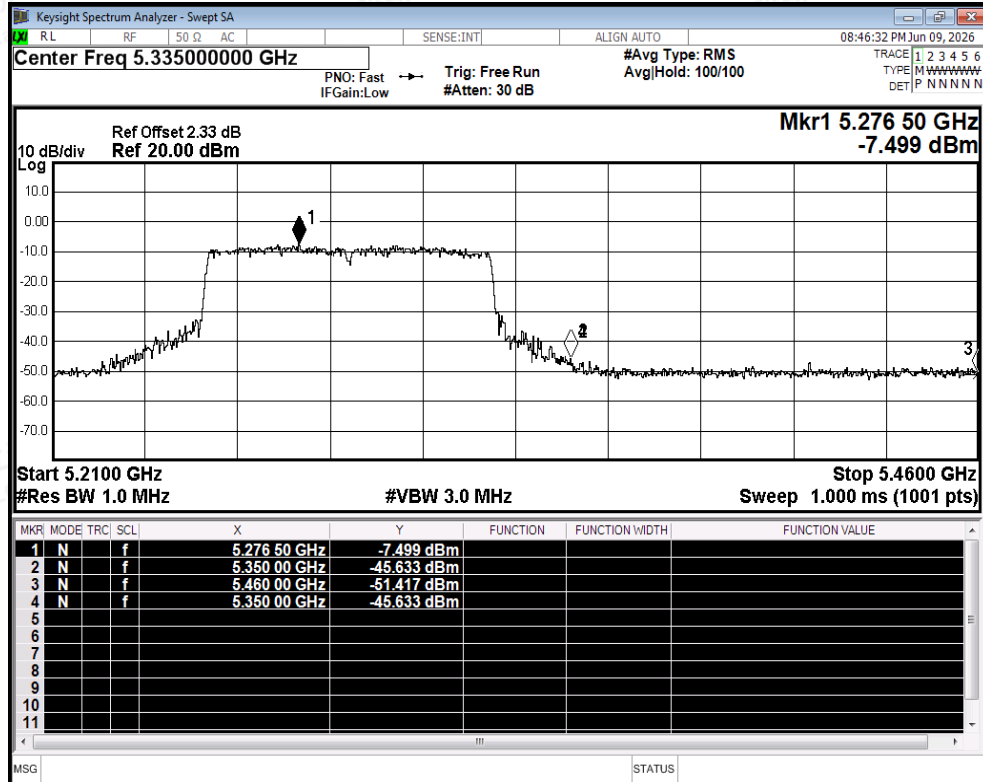

Restrict Band NVNT ax80 5290MHz Ant1 Peak

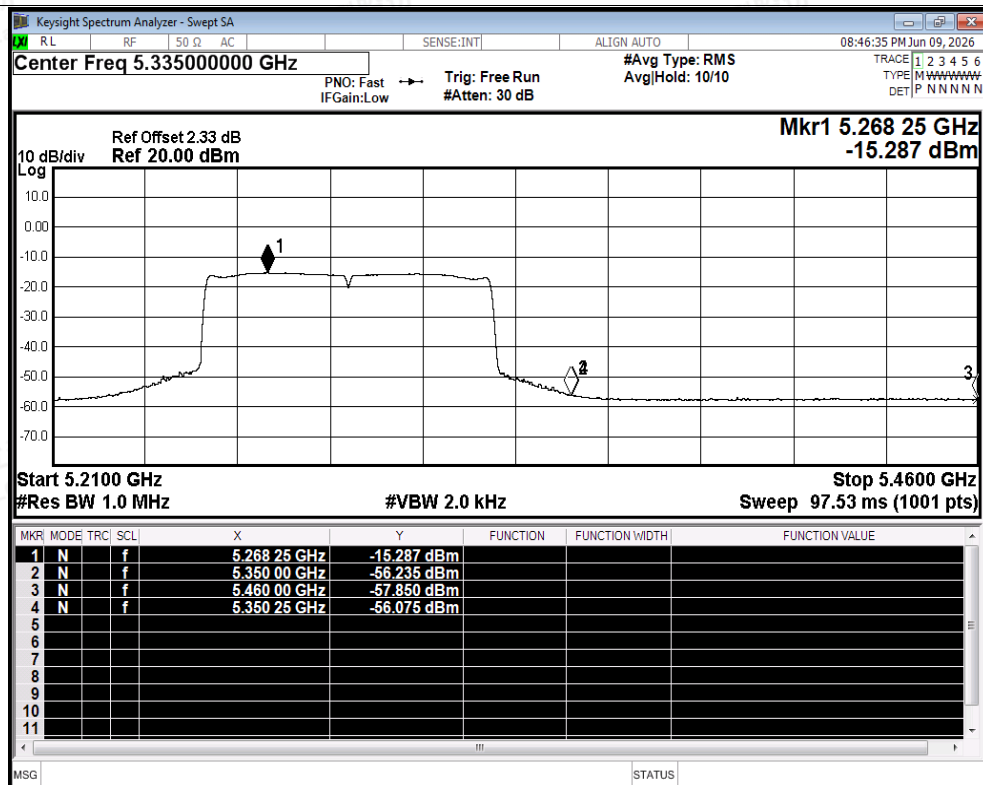

Restrict Band NVNT ax80 5290MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

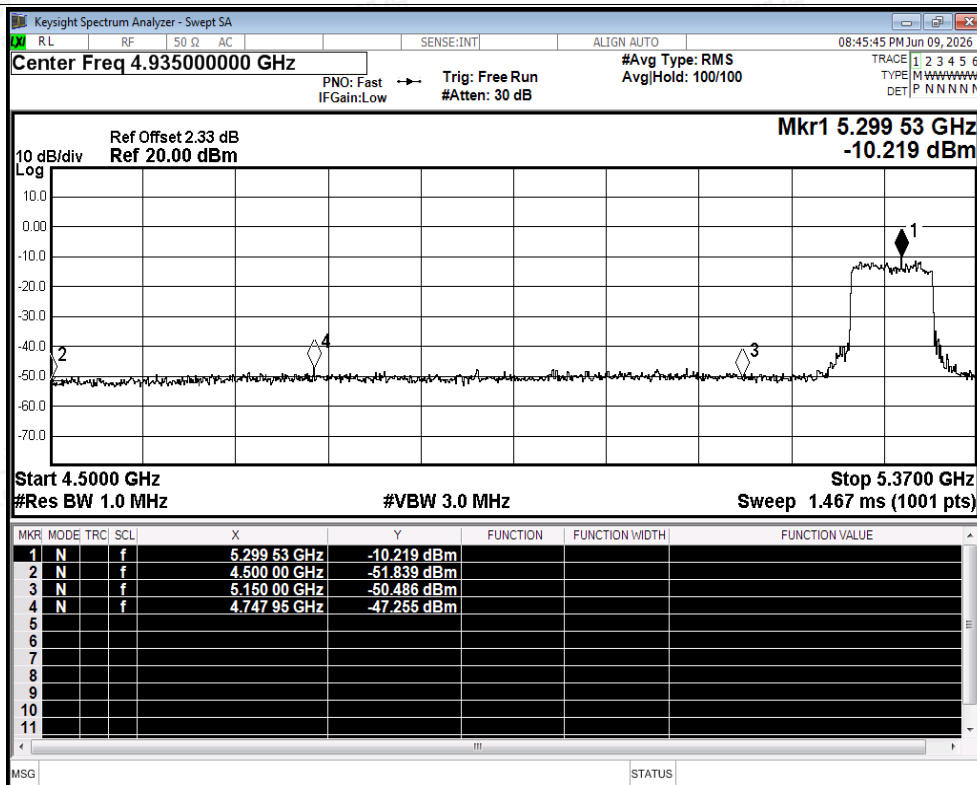

Restrict Band NVNT ax80 5290MHz Ant1 Peak

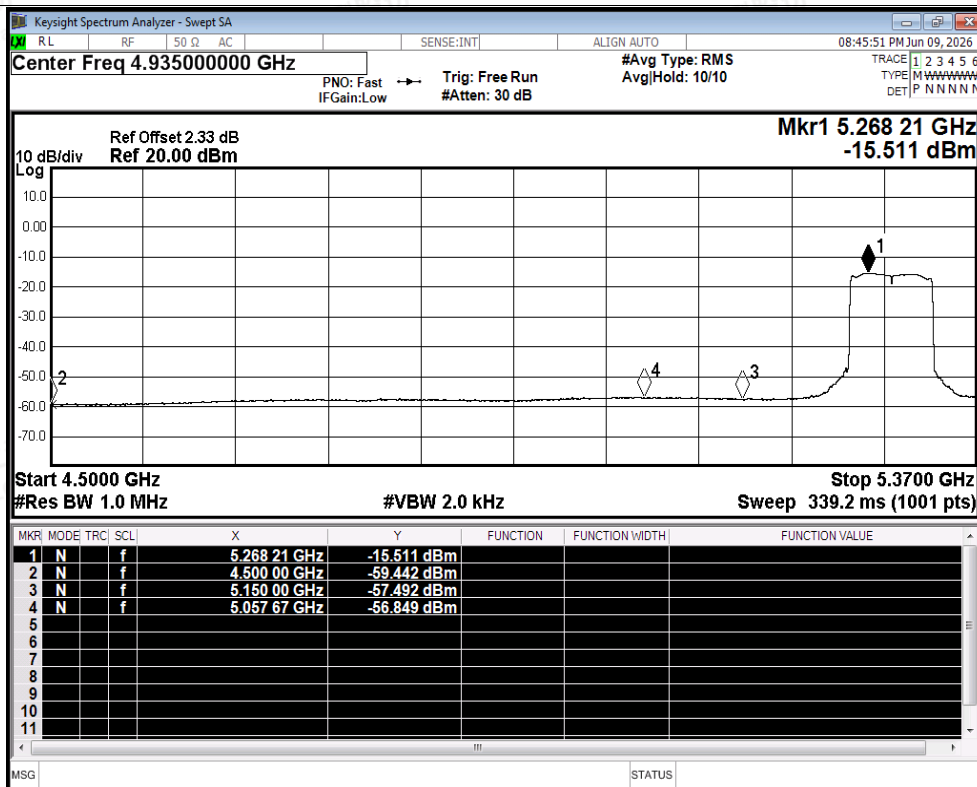

Restrict Band NVNT ax80 5290MHz Ant1 Average



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



MIMO

Condition	Mode	Frequency (MHz)	E (dBuV/m)			Detector	Limit (dBuV/m)	Verdict
			Ant1	Ant2	Ant1+ Ant2			
NVNT	n20	5260	49.9	45.73	54.08	Peak	68.2	Pass
NVNT	n20	5260	41.74	38.21	46.17	Average	54	Pass
NVNT	n20	5260	54.65	50.1	58.69	Peak	68.2	Pass
NVNT	n20	5260	44.13	40.41	48.49	Average	54	Pass
NVNT	n20	5260	50.97	46.67	55.10	Peak	68.2	Pass
NVNT	n20	5260	43.75	39.99	48.09	Average	54	Pass
NVNT	n20	5320	55.74	50.63	59.58	Peak	68.2	Pass
NVNT	n20	5320	45.56	41.46	49.77	Average	54	Pass
NVNT	n20	5320	58.26	54.1	62.45	Peak	68.2	Pass
NVNT	n20	5320	45.56	41.46	49.77	Average	54	Pass
NVNT	n20	5320	50.52	48.09	55.41	Peak	68.2	Pass
NVNT	n20	5320	42.91	39.28	47.30	Average	54	Pass
NVNT	n40	5270	49.08	45.27	53.40	Peak	68.2	Pass
NVNT	n40	5270	41.77	38	46.11	Average	54	Pass
NVNT	n40	5270	53.41	50.83	58.24	Peak	68.2	Pass
NVNT	n40	5270	44.36	40.59	48.70	Average	54	Pass
NVNT	n40	5270	51.89	46.52	55.63	Peak	68.2	Pass
NVNT	n40	5270	43.4	39.62	47.73	Average	54	Pass
NVNT	n40	5310	55.53	51.35	59.71	Peak	68.2	Pass
NVNT	n40	5310	44.41	40.94	48.87	Average	54	Pass
NVNT	n40	5310	55.53	52.45	60.15	Peak	68.2	Pass
NVNT	n40	5310	44.83	40.94	49.12	Average	54	Pass
NVNT	n40	5310	49.78	46.68	54.39	Peak	68.2	Pass
NVNT	n40	5310	43.07	39.46	47.47	Average	54	Pass
NVNT	ac20	5260	49.56	45.34	53.72	Peak	68.2	Pass
NVNT	ac20	5260	41.95	38.16	46.28	Average	54	Pass
NVNT	ac20	5260	53.84	50.94	58.53	Peak	68.2	Pass
NVNT	ac20	5260	44.14	40.4	48.49	Average	54	Pass
NVNT	ac20	5260	51	46.77	55.16	Peak	68.2	Pass
NVNT	ac20	5260	43.6	40.05	48.03	Average	54	Pass
NVNT	ac20	5320	56.93	52.08	60.86	Peak	68.2	Pass
NVNT	ac20	5320	45.92	42.98	50.59	Average	54	Pass
NVNT	ac20	5320	59.74	56.52	64.30	Peak	68.2	Pass
NVNT	ac20	5320	45.92	42.98	50.59	Average	54	Pass
NVNT	ac20	5320	50.54	45.6	54.44	Peak	68.2	Pass
NVNT	ac20	5320	43.12	39.28	47.43	Average	54	Pass
NVNT	ac40	5270	48.21	44.35	52.51	Peak	68.2	Pass
NVNT	ac40	5270	41.53	37.88	45.92	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac40	5270	53.54	49.68	57.84	Peak	68.2	Pass
NVNT	ac40	5270	44.44	40.81	48.83	Average	54	Pass
NVNT	ac40	5270	49.96	47.71	54.93	Peak	68.2	Pass
NVNT	ac40	5270	43.32	39.77	47.75	Average	54	Pass
NVNT	ac40	5310	56.55	51.76	60.50	Peak	68.2	Pass
NVNT	ac40	5310	44.48	40.83	48.87	Average	54	Pass
NVNT	ac40	5310	56.95	52.73	61.11	Peak	68.2	Pass
NVNT	ac40	5310	44.48	40.98	48.93	Average	54	Pass
NVNT	ac40	5310	49.96	45.49	54.03	Peak	68.2	Pass
NVNT	ac40	5310	43.25	39.41	47.56	Average	54	Pass
NVNT	ac80	5290	54.02	47.84	57.49	Peak	68.2	Pass
NVNT	ac80	5290	45.12	41.19	49.40	Average	54	Pass
NVNT	ac80	5290	55.89	53.12	60.64	Peak	68.2	Pass
NVNT	ac80	5290	45.12	41.21	49.40	Average	54	Pass
NVNT	ac80	5290	49.5	46.38	54.10	Peak	68.2	Pass
NVNT	ac80	5290	43.39	39.68	47.75	Average	54	Pass
NVNT	ac80	5290	49.19	45.78	53.67	Peak	68.2	Pass
NVNT	ac80	5290	41.72	37.93	46.05	Average	54	Pass
NVNT	ac80	5290	53	49.62	57.49	Peak	68.2	Pass
NVNT	ac80	5290	44.33	40.58	48.68	Average	54	Pass
NVNT	ac80	5290	49.86	46.96	54.55	Peak	68.2	Pass
NVNT	ac80	5290	43.44	39.54	47.73	Average	54	Pass
NVNT	ax20	5260	50.16	45.06	54.00	Peak	68.2	Pass
NVNT	ax20	5260	41.87	38.13	46.22	Average	54	Pass
NVNT	ax20	5260	54.41	49.65	58.37	Peak	68.2	Pass
NVNT	ax20	5260	44.13	40.39	48.48	Average	54	Pass
NVNT	ax20	5260	51.8	48.18	56.20	Peak	68.2	Pass
NVNT	ax20	5260	43.76	40.02	48.11	Average	54	Pass
NVNT	ax20	5320	58.51	57.15	63.88	Peak	68.2	Pass
NVNT	ax20	5320	45.95	42.78	50.53	Average	54	Pass
NVNT	ax20	5320	58.51	59.52	65.05	Peak	68.2	Pass
NVNT	ax20	5320	45.95	42.78	50.53	Average	54	Pass
NVNT	ax20	5320	51.15	46.41	55.12	Peak	68.2	Pass
NVNT	ax20	5320	43	39.23	47.34	Average	54	Pass
NVNT	ax40	5270	48.91	45.03	53.21	Peak	68.2	Pass
NVNT	ax40	5270	41.82	37.87	46.09	Average	54	Pass
NVNT	ax40	5270	53.44	49.48	57.70	Peak	68.2	Pass
NVNT	ax40	5270	44.51	40.88	48.90	Average	54	Pass
NVNT	ax40	5270	49.67	47.7	54.76	Peak	68.2	Pass
NVNT	ax40	5270	43.45	39.79	47.83	Average	54	Pass
NVNT	ax40	5310	53.03	49.17	57.33	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax40	5310	44.43	41.23	49.00	Average	54	Pass
NVNT	ax40	5310	55.87	51.47	59.97	Peak	68.2	Pass
NVNT	ax40	5310	44.43	41.23	49.00	Average	54	Pass
NVNT	ax40	5310	49.42	46.06	53.92	Peak	68.2	Pass
NVNT	ax40	5310	43.14	39.33	47.46	Average	54	Pass
NVNT	ax80	5290	52.46	51.63	58.08	Peak	68.2	Pass
NVNT	ax80	5290	44.87	41.03	49.18	Average	54	Pass
NVNT	ax80	5290	54.11	51.63	58.98	Peak	68.2	Pass
NVNT	ax80	5290	44.9	41.19	49.26	Average	54	Pass
NVNT	ax80	5290	50.98	45.85	54.81	Peak	68.2	Pass
NVNT	ax80	5290	43.2	39.42	47.53	Average	54	Pass
NVNT	ax80	5290	48.16	45.43	52.92	Peak	68.2	Pass
NVNT	ax80	5290	41.62	37.82	45.95	Average	54	Pass
NVNT	ax80	5290	53.42	50.01	57.90	Peak	68.2	Pass
NVNT	ax80	5290	44.16	40.42	48.51	Average	54	Pass
NVNT	ax80	5290	49.6	46.18	54.08	Peak	68.2	Pass
NVNT	ax80	5290	43.53	39.63	47.82	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



E.5 Frequency Stability

Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5260	Ant1	5259.98	-20000	-3.8	25	Pass
NVNT	a	5280	Ant1	5279.98	-20000	-3.79	25	Pass
NVNT	a	5320	Ant1	5319.98	-20000	-3.76	25	Pass
NVNT	n20	5260	Ant1	5259.98	-20000	-3.8	25	Pass
NVNT	n20	5280	Ant1	5279.96	-40000	-7.58	25	Pass
NVNT	n20	5320	Ant1	5319.98	-20000	-3.76	25	Pass
NVNT	n40	5270	Ant1	5269.96	-40000	-7.59	25	Pass
NVNT	n40	5310	Ant1	5310	0	0	25	Pass
NVNT	ac20	5260	Ant1	5259.96	-40000	-7.6	25	Pass
NVNT	ac20	5280	Ant1	5279.96	-40000	-7.58	25	Pass
NVNT	ac20	5320	Ant1	5319.98	-20000	-3.76	25	Pass
NVNT	ac40	5270	Ant1	5269.96	-40000	-7.59	25	Pass
NVNT	ac40	5310	Ant1	5309.96	-40000	-7.53	25	Pass
NVNT	ac80	5290	Ant1	5290	0	0	25	Pass
NVNT	ax20	5260	Ant1	5259.98	-20000	-3.8	25	Pass
NVNT	ax20	5280	Ant1	5279.96	-40000	-7.58	25	Pass
NVNT	ax20	5320	Ant1	5319.96	-40000	-7.52	25	Pass
NVNT	ax40	5270	Ant1	5269.96	-40000	-7.59	25	Pass
NVNT	ax40	5310	Ant1	5309.96	-40000	-7.53	25	Pass
NVNT	ax80	5290	Ant1	5290	0	0	25	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

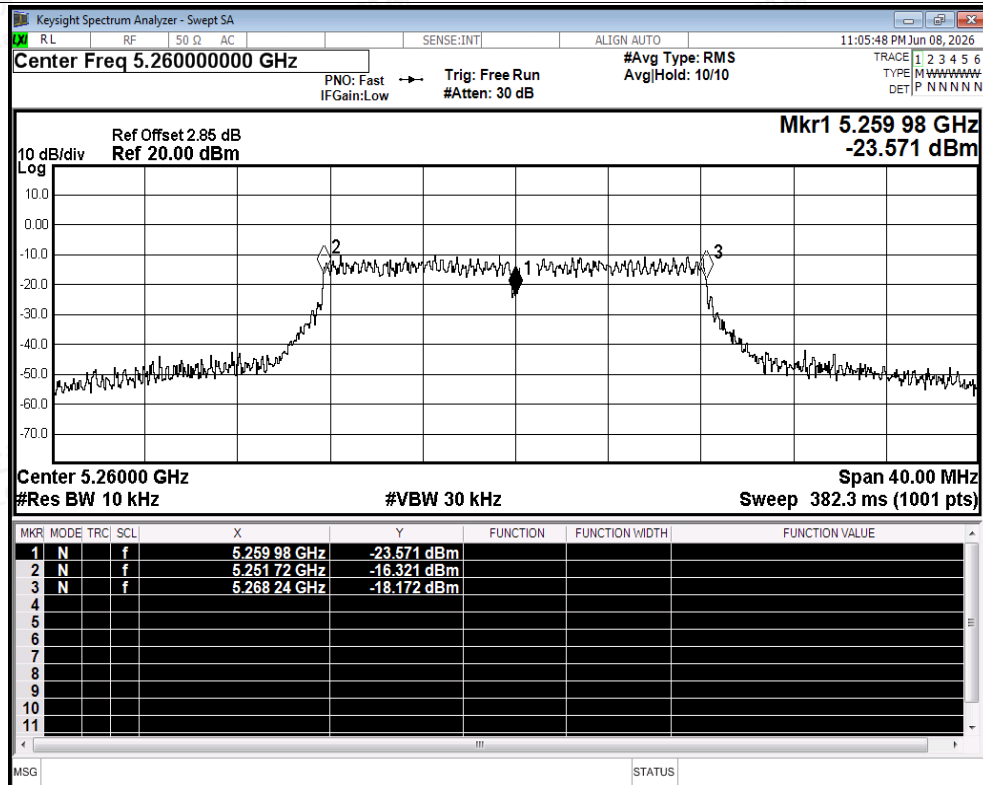

Freq. Stability NVNT a 5260MHz Ant1

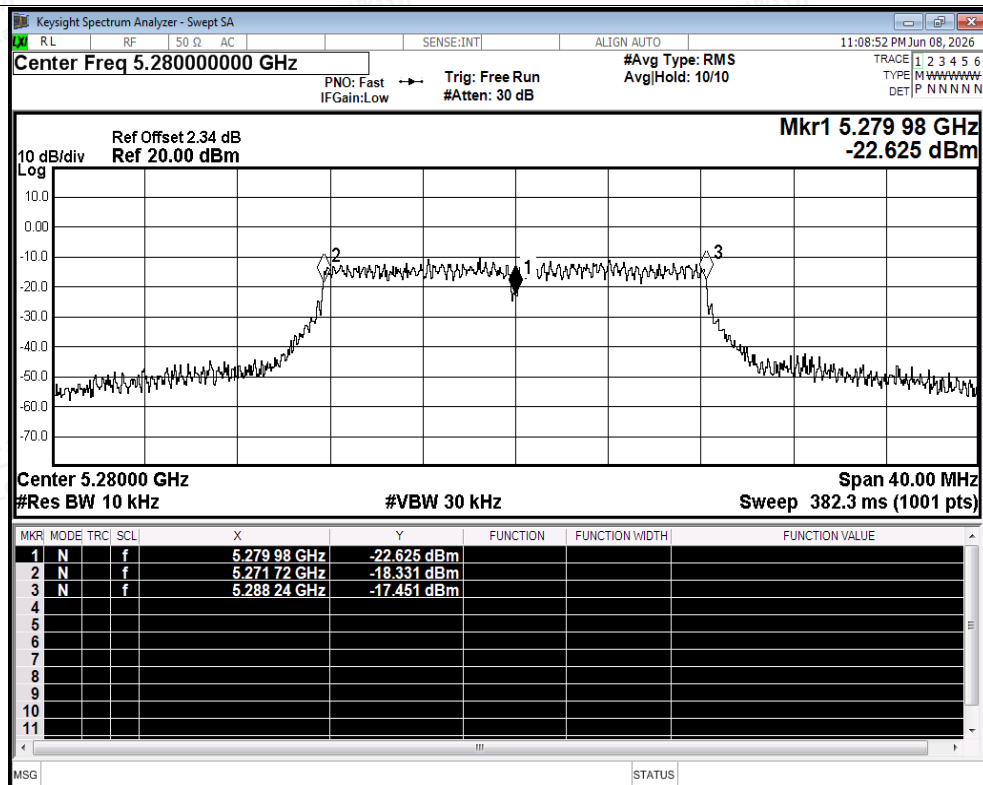

Freq. Stability NVNT a 5280MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

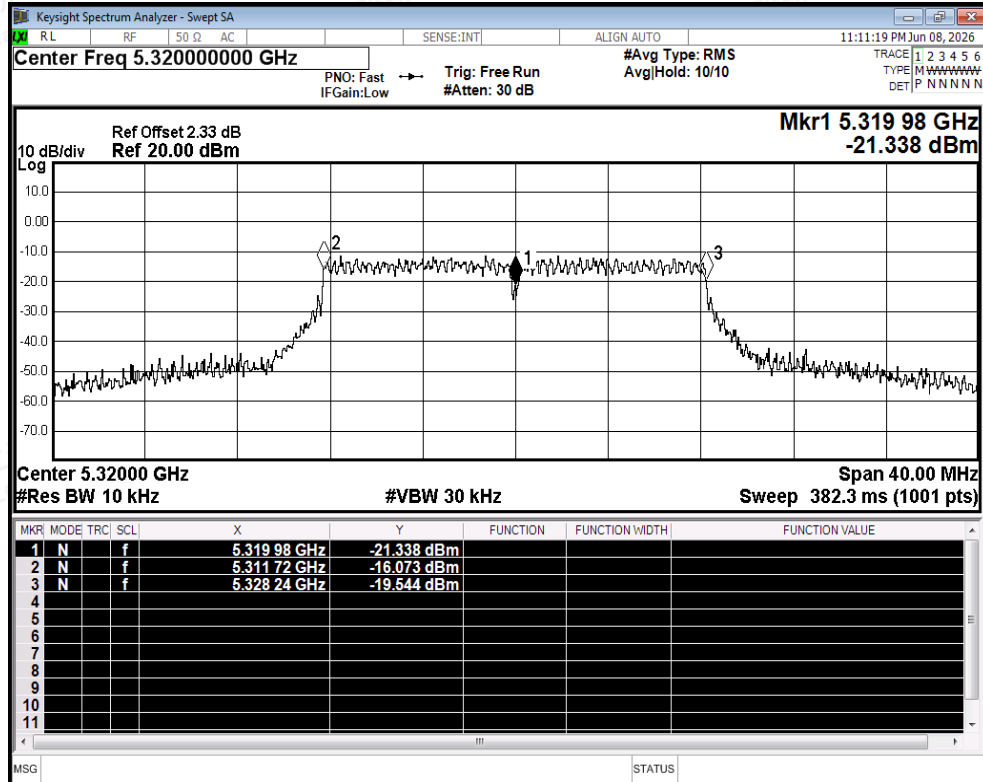

Freq. Stability NVNT a 5320MHz Ant1

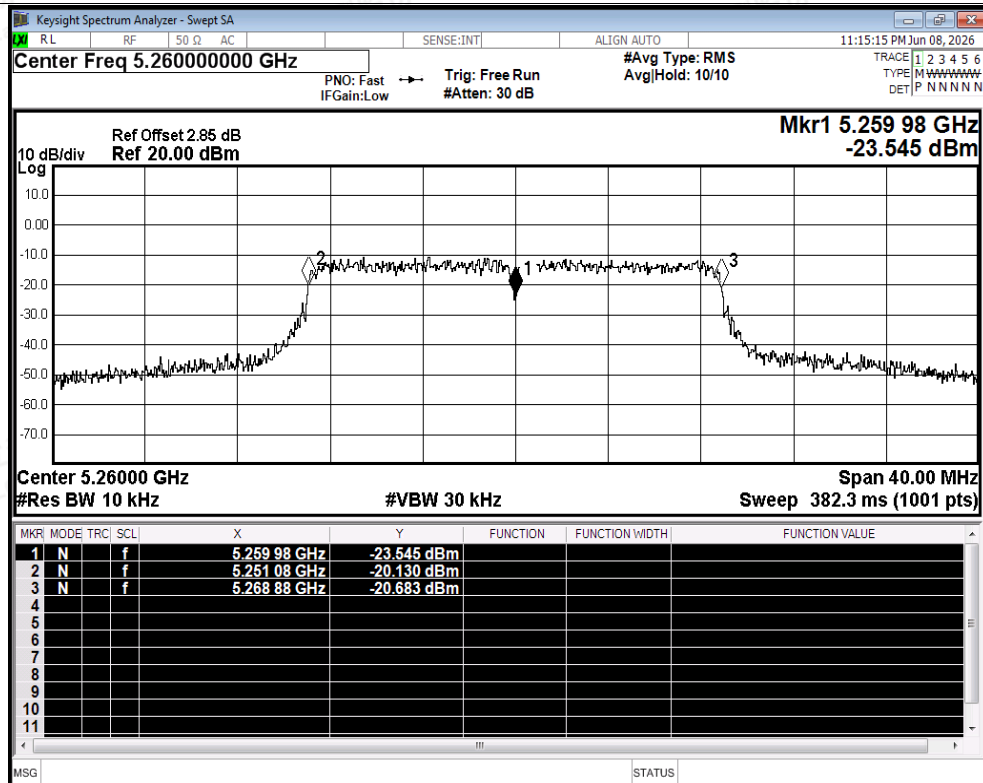

Freq. Stability NVNT n20 5260MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

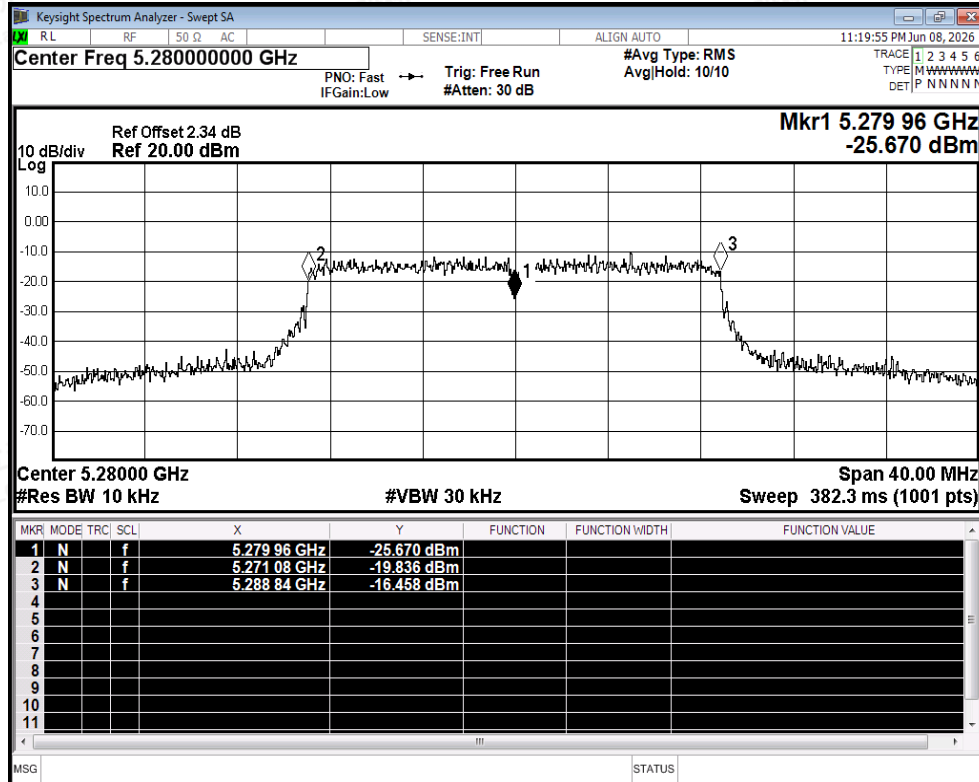

Freq. Stability NVNT n20 5280MHz Ant1

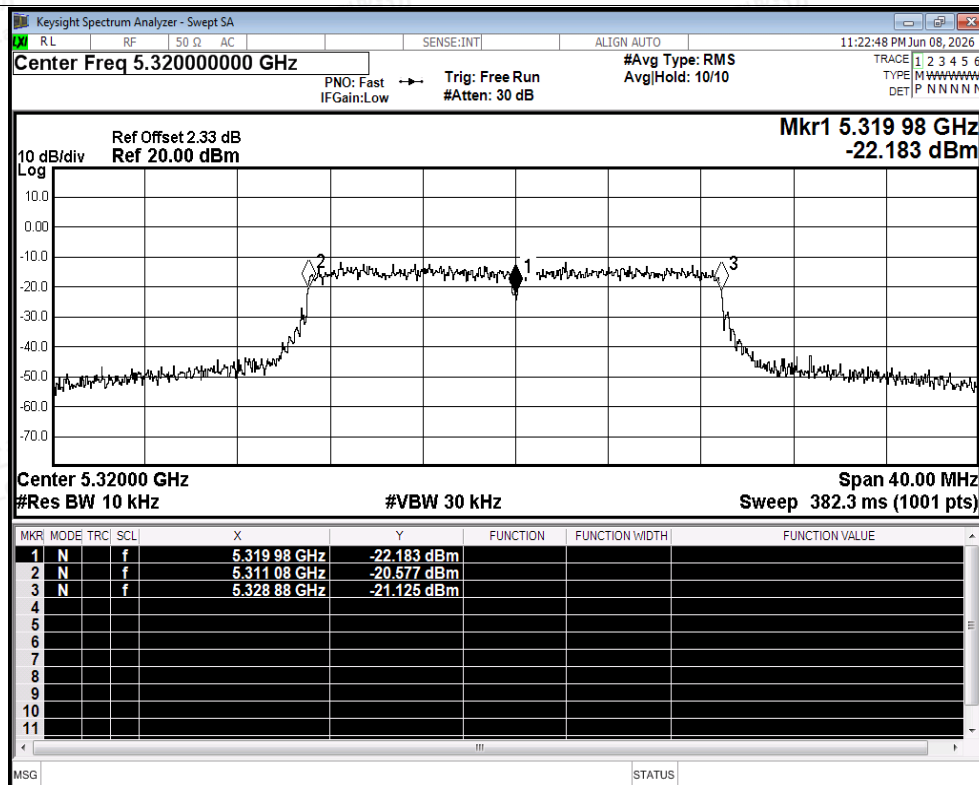

Freq. Stability NVNT n20 5320MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

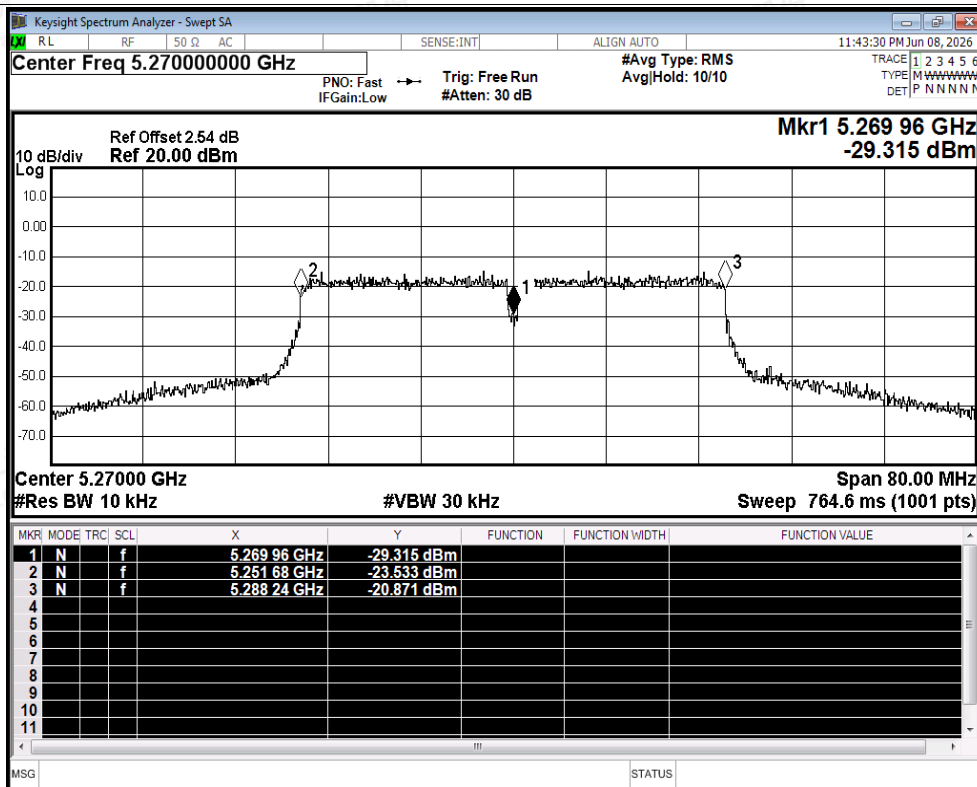

Freq. Stability NVNT n40 5270MHz Ant1

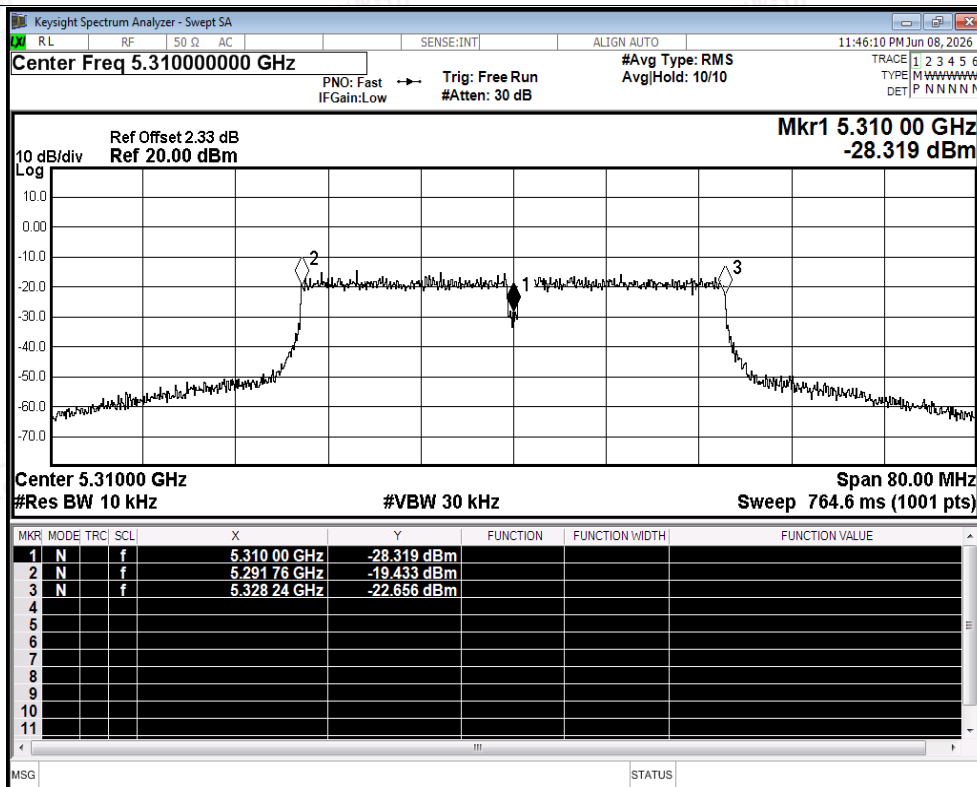

Freq. Stability NVNT n40 5310MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

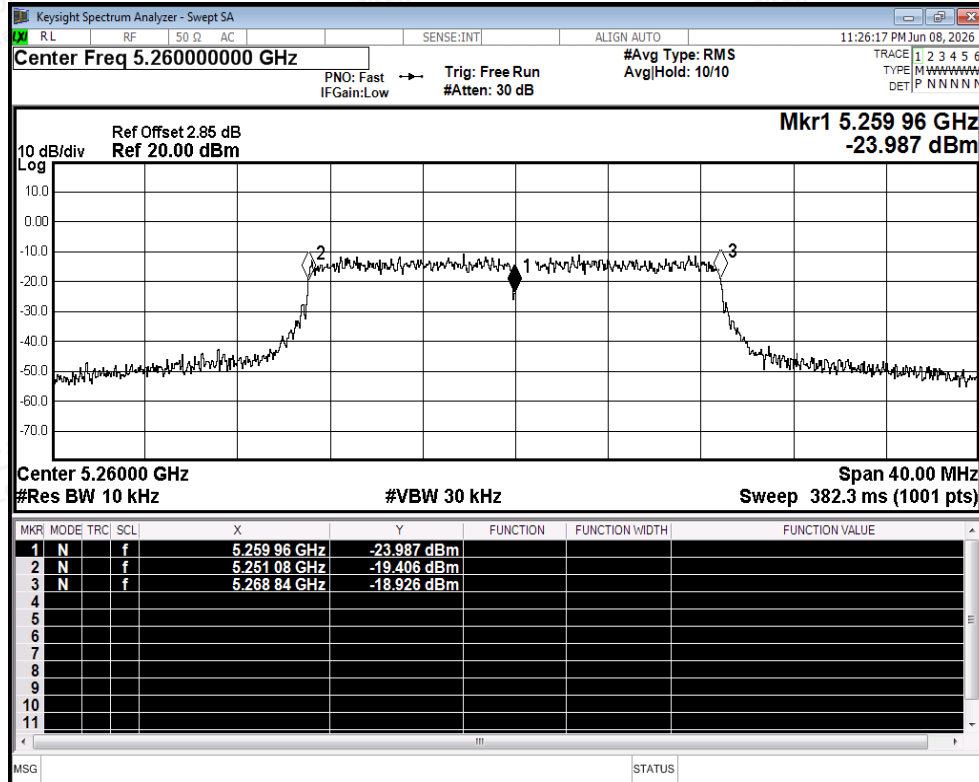

Freq. Stability NVNT ac20 5260MHz Ant1

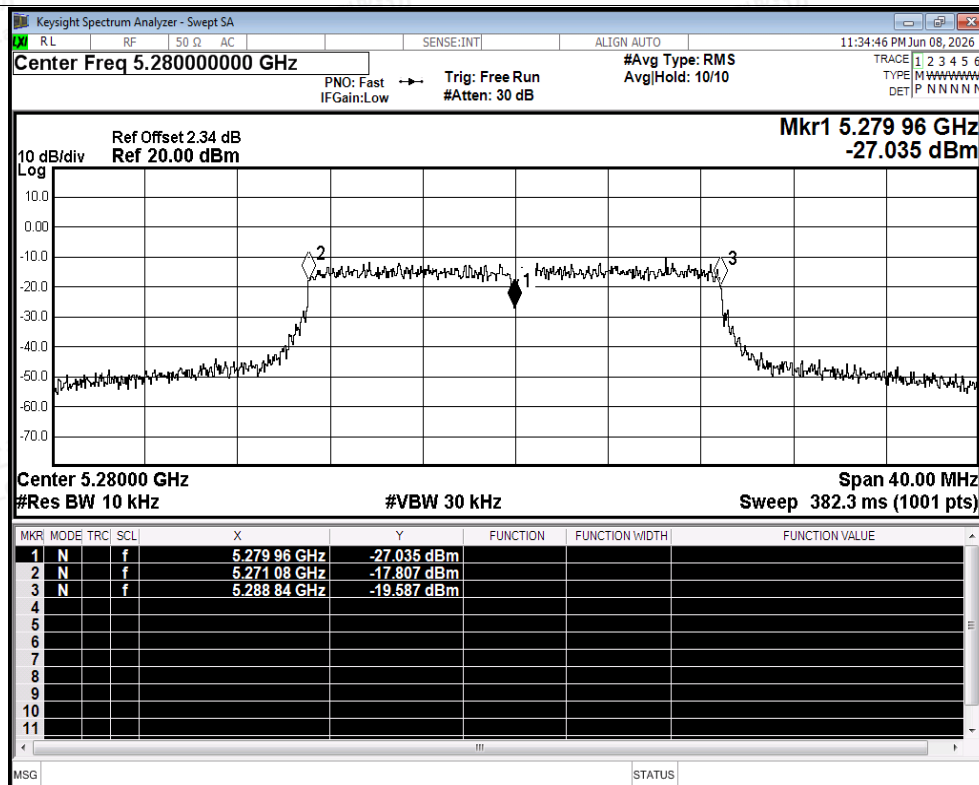

Freq. Stability NVNT ac20 5280MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

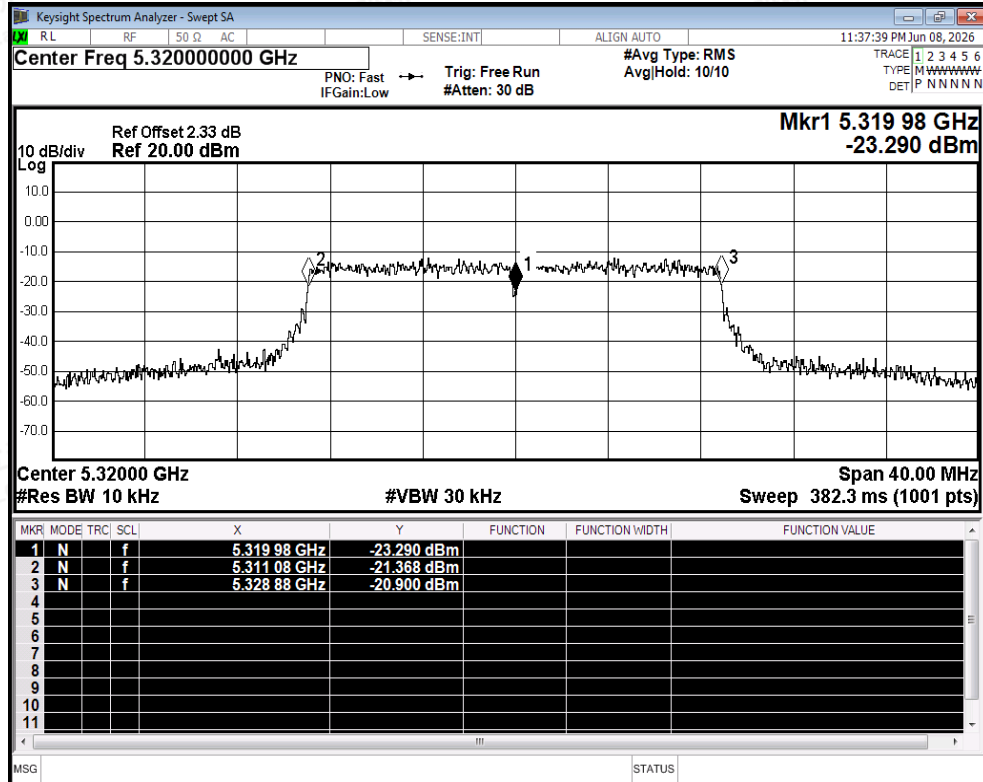

Freq. Stability NVNT ac20 5320MHz Ant1

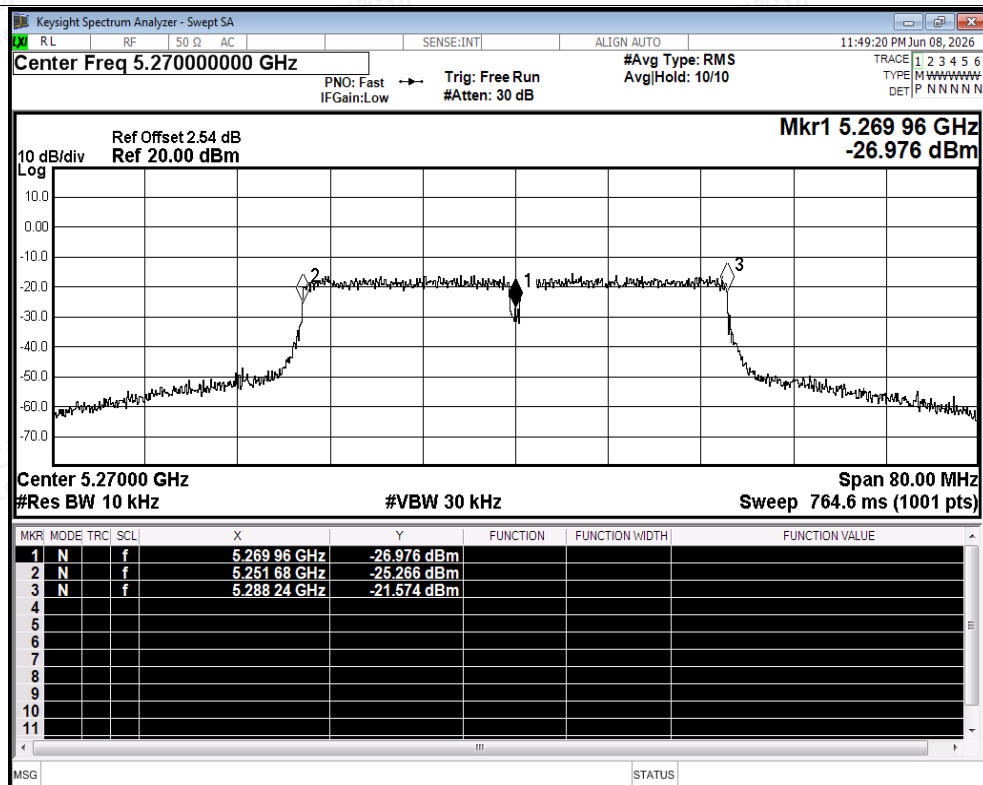

Freq. Stability NVNT ac40 5270MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

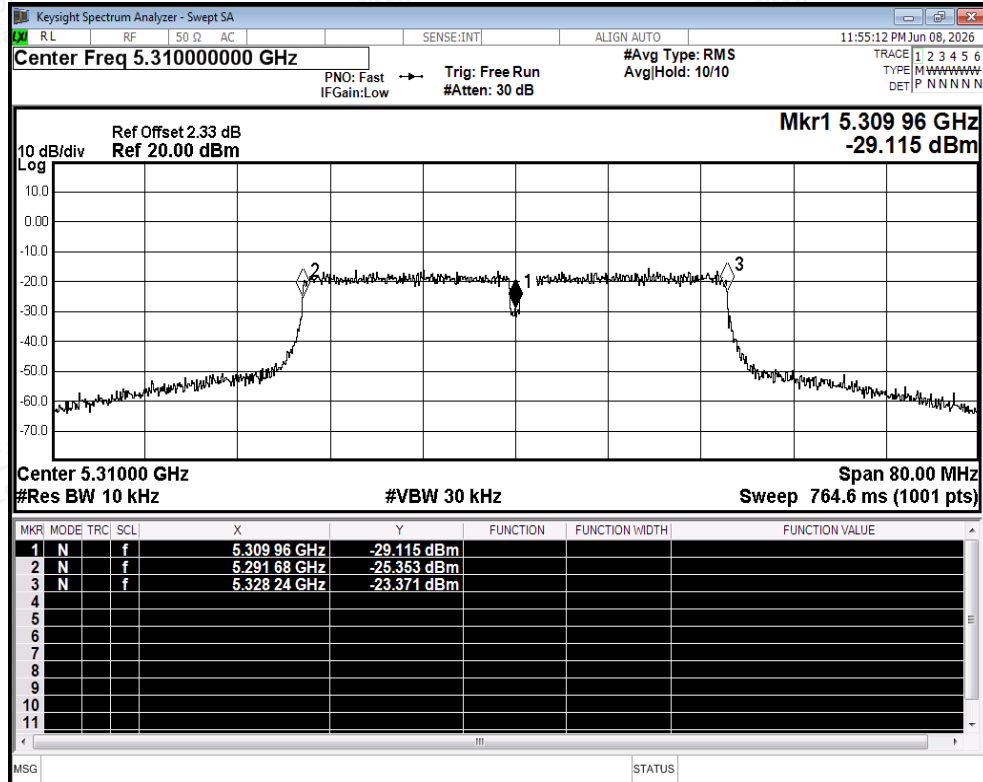

Freq. Stability NVNT ac40 5310MHz Ant1

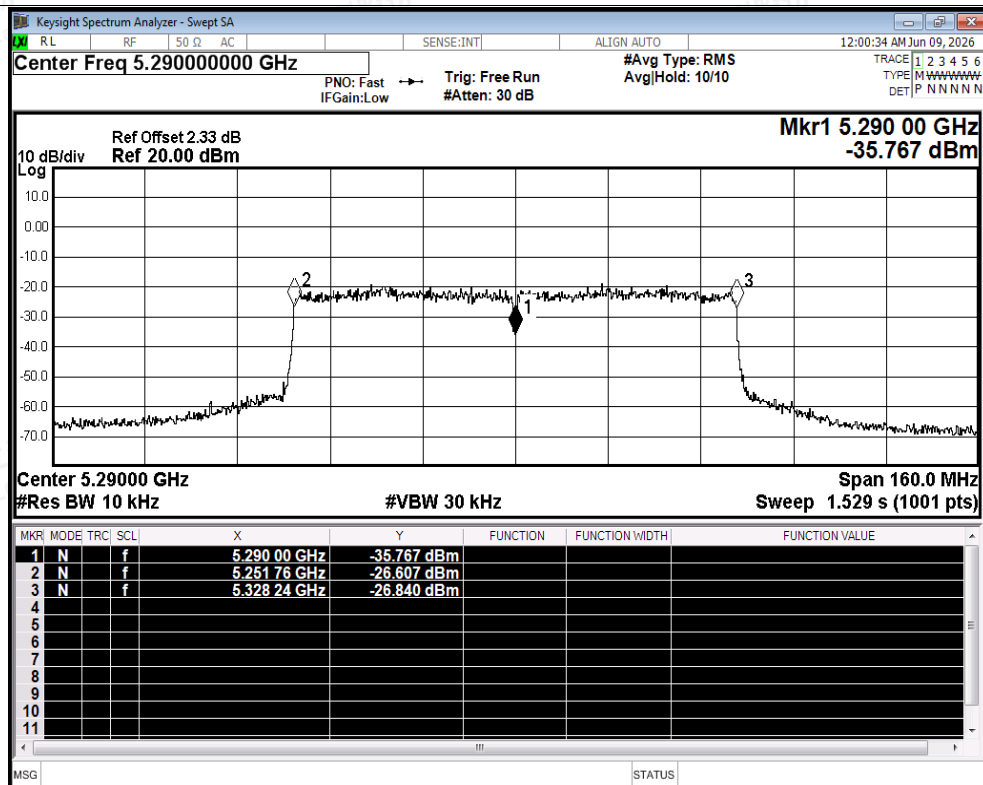

Freq. Stability NVNT ac80 5290MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

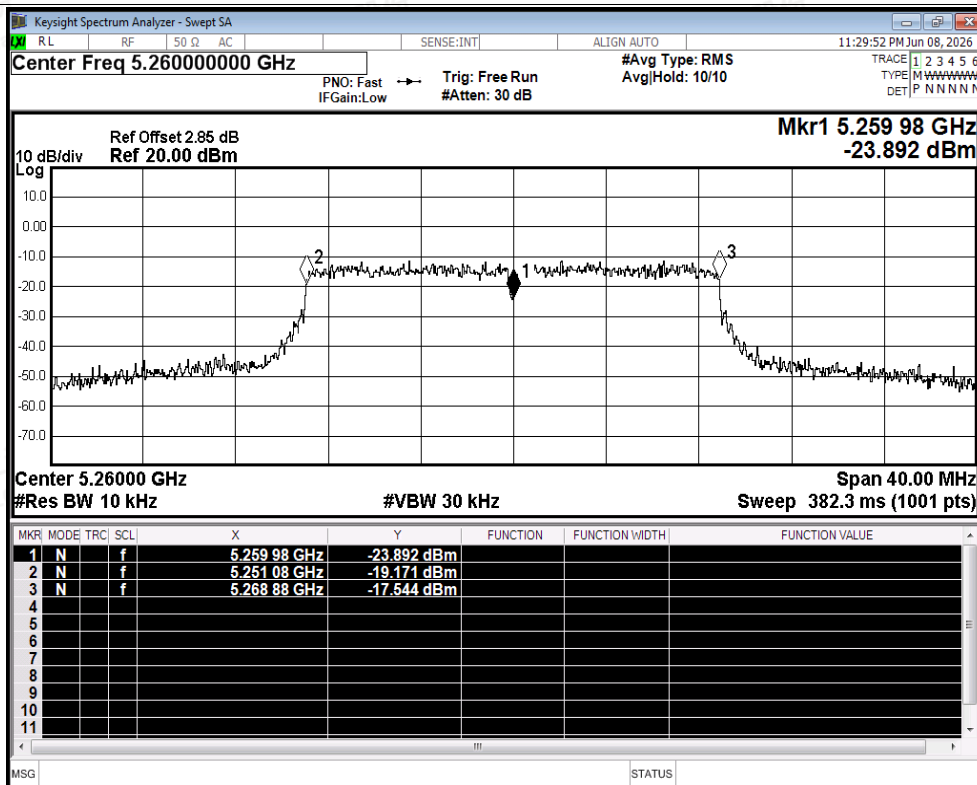

Freq. Stability NVNT ax20 5260MHz Ant1

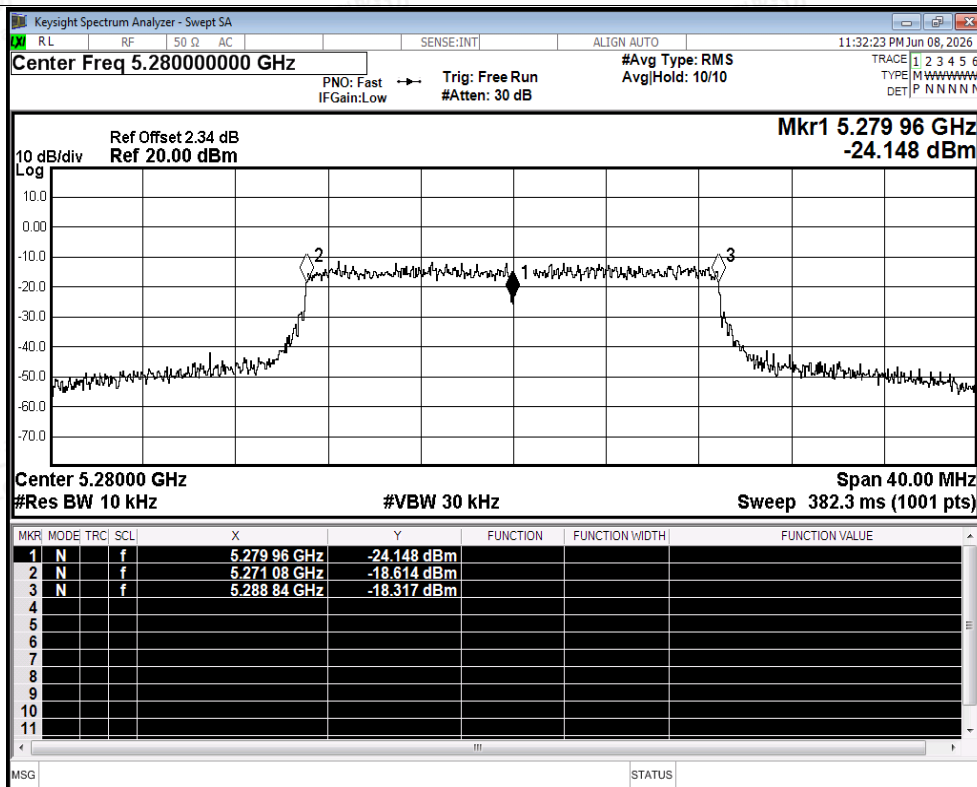

Freq. Stability NVNT ax20 5280MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

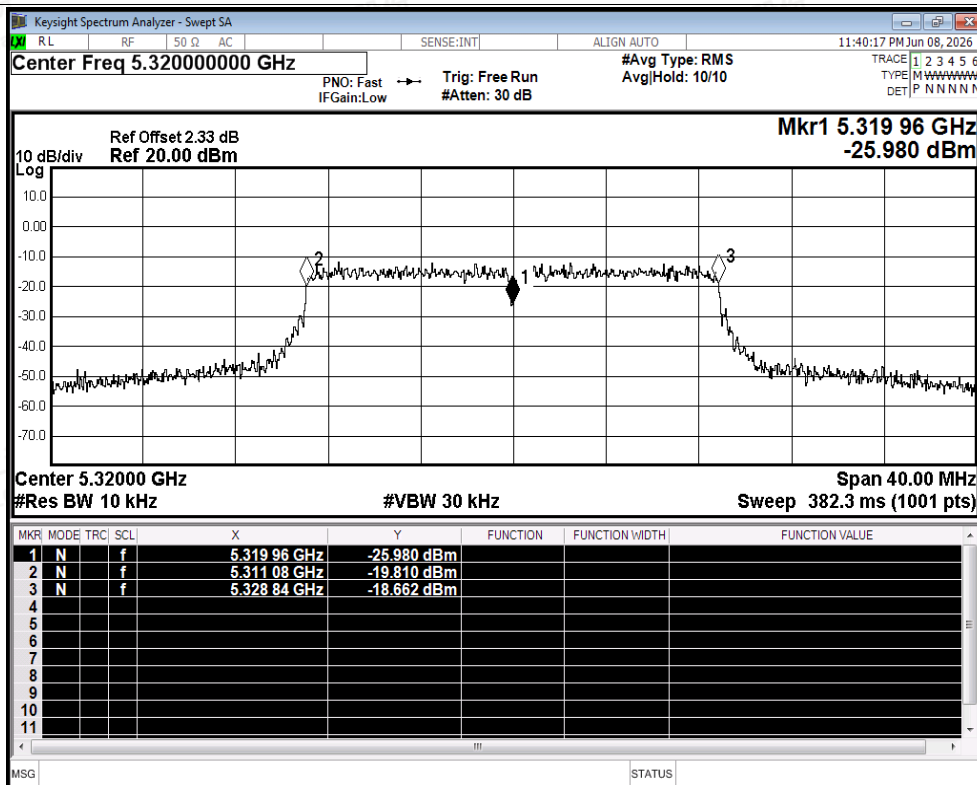

Freq. Stability NVNT ax20 5320MHz Ant1

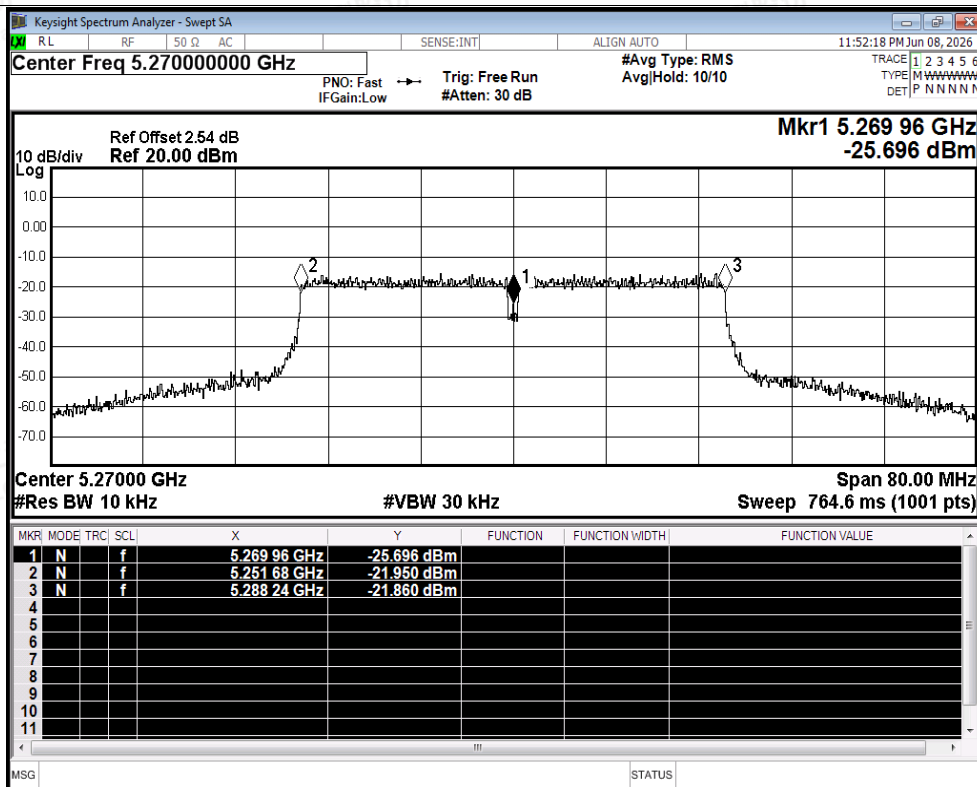

Freq. Stability NVNT ax40 5270MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

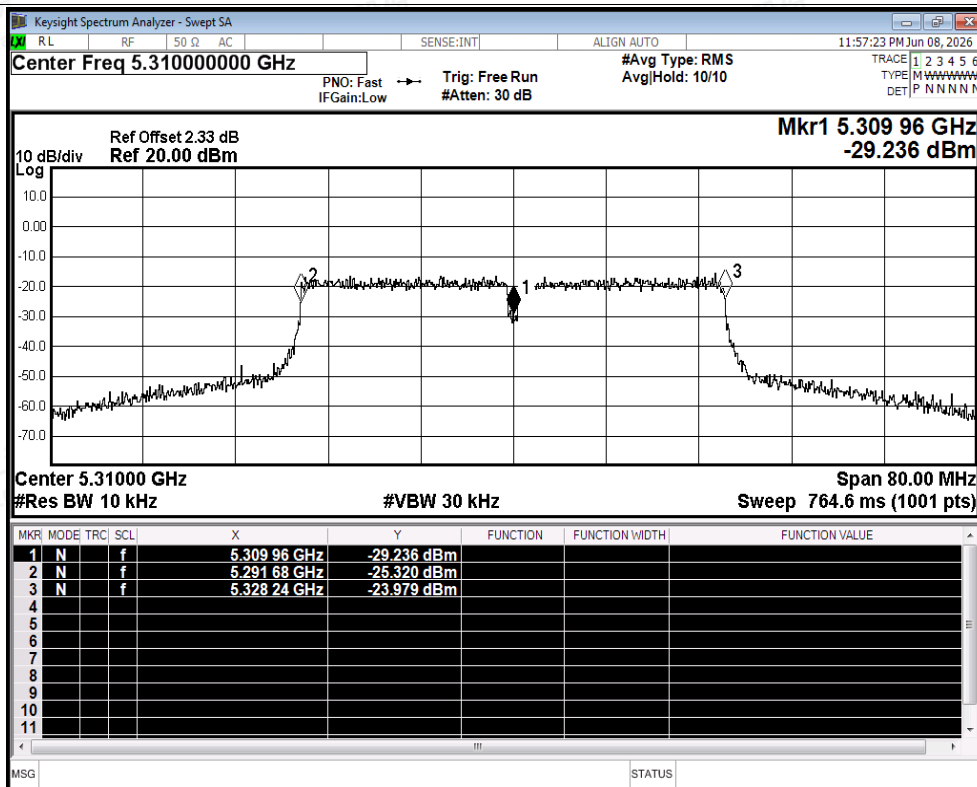

Freq. Stability NVNT ax40 5310MHz Ant1

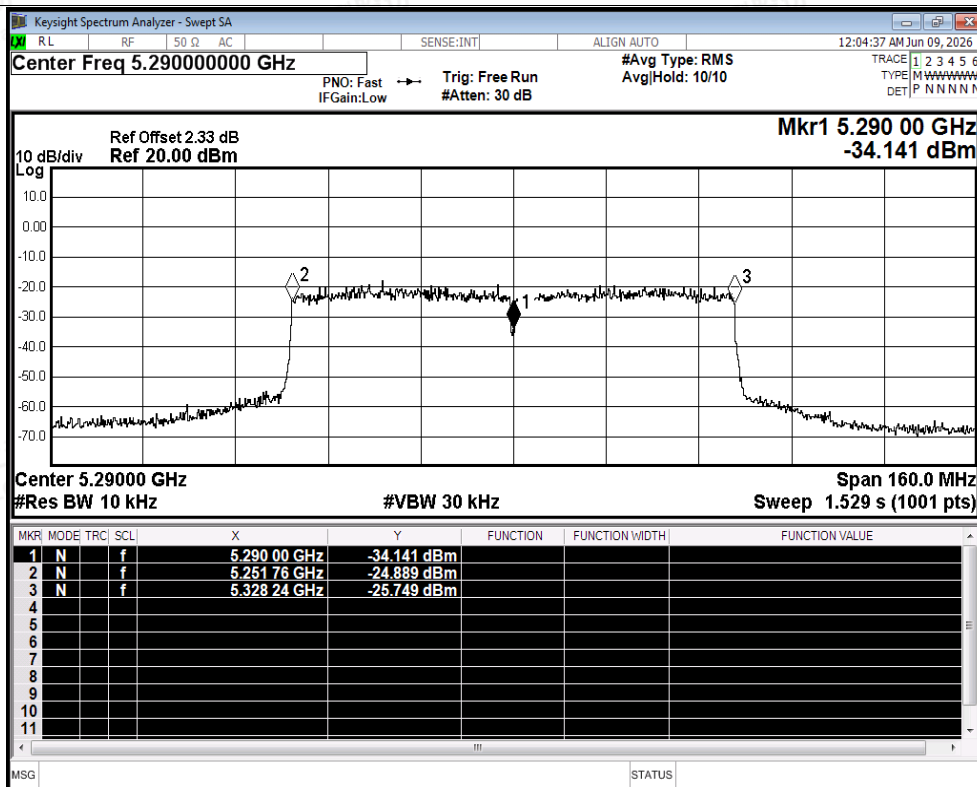

Freq. Stability NVNT ax80 5290MHz Ant1



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5260	Ant2	5259.98	-20000	-3.8	25	Pass
NVNT	a	5280	Ant2	5279.98	-20000	-3.79	25	Pass
NVNT	a	5320	Ant2	5320	0	0	25	Pass
NVNT	n20	5260	Ant2	5260	0	0	25	Pass
NVNT	n20	5280	Ant2	5279.98	-20000	-3.79	25	Pass
NVNT	n20	5320	Ant2	5319.98	-20000	-3.76	25	Pass
NVNT	n40	5270	Ant2	5270	0	0	25	Pass
NVNT	n40	5310	Ant2	5310	0	0	25	Pass
NVNT	ac20	5260	Ant2	5259.98	-20000	-3.8	25	Pass
NVNT	ac20	5280	Ant2	5279.98	-20000	-3.79	25	Pass
NVNT	ac20	5320	Ant2	5319.98	-20000	-3.76	25	Pass
NVNT	ac40	5270	Ant2	5269.96	-40000	-7.59	25	Pass
NVNT	ac40	5310	Ant2	5309.96	-40000	-7.53	25	Pass
NVNT	ac80	5290	Ant2	5290	0	0	25	Pass
NVNT	ax20	5260	Ant2	5259.98	-20000	-3.8	25	Pass
NVNT	ax20	5280	Ant2	5280	0	0	25	Pass
NVNT	ax20	5320	Ant2	5319.98	-20000	-3.76	25	Pass
NVNT	ax40	5270	Ant2	5270	0	0	25	Pass
NVNT	ax40	5310	Ant2	5310	0	0	25	Pass
NVNT	ax80	5290	Ant2	5290	0	0	25	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

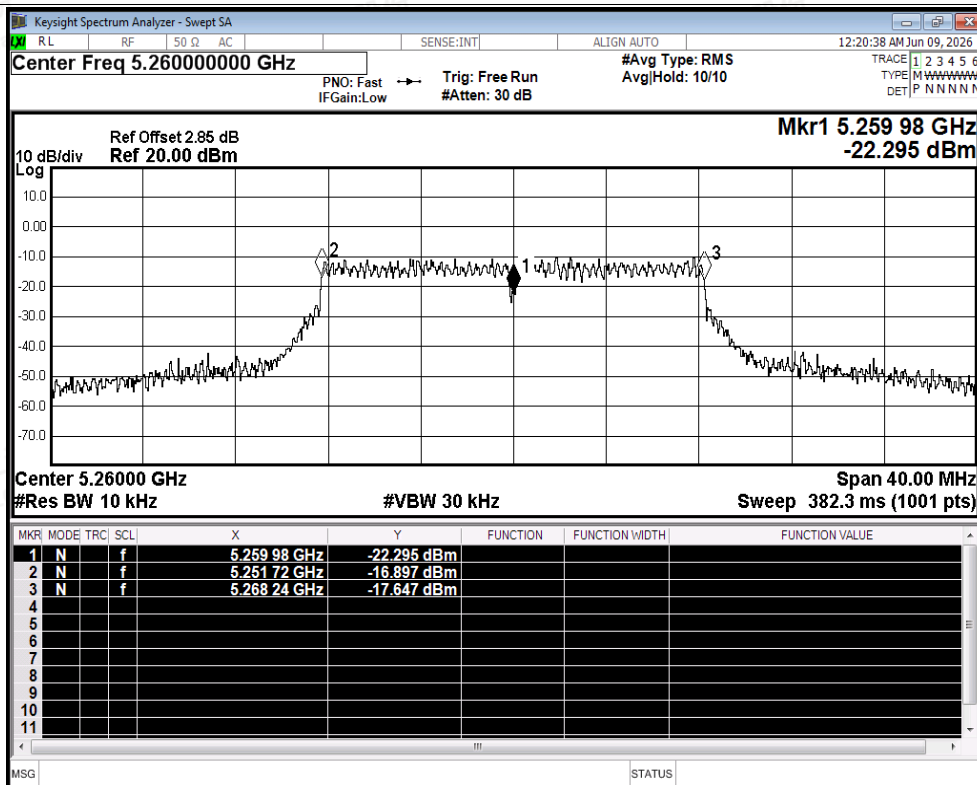

Freq. Stability NVNT a 5260MHz Ant2

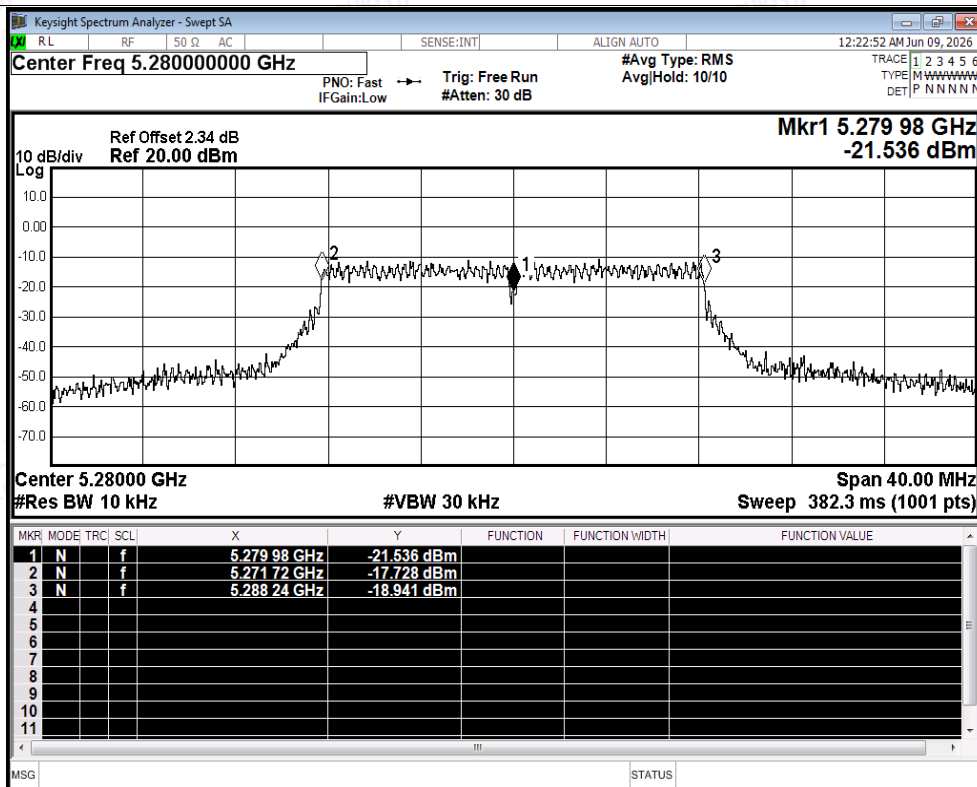

Freq. Stability NVNT a 5280MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

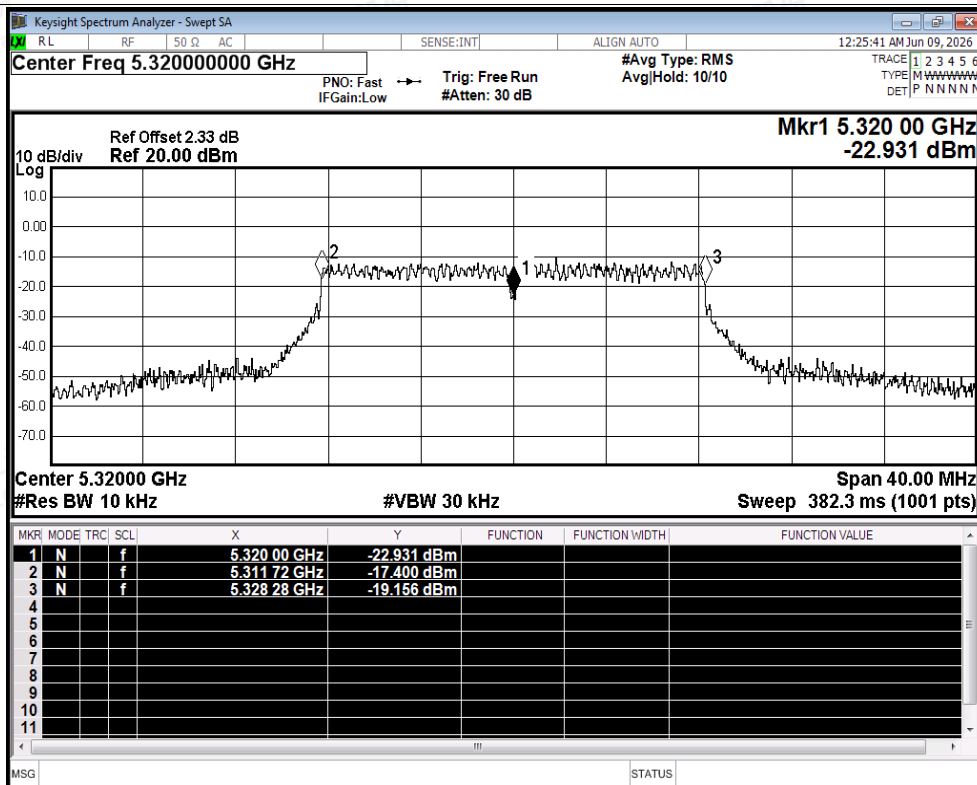

Freq. Stability NVNT a 5320MHz Ant2

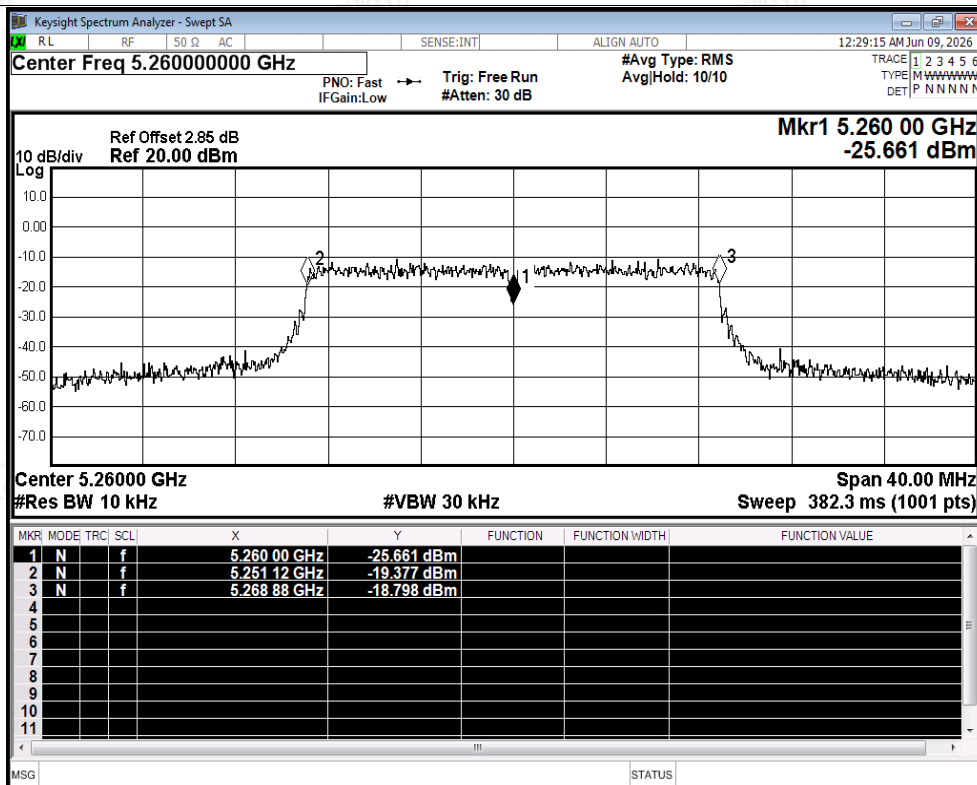

Freq. Stability NVNT n20 5260MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

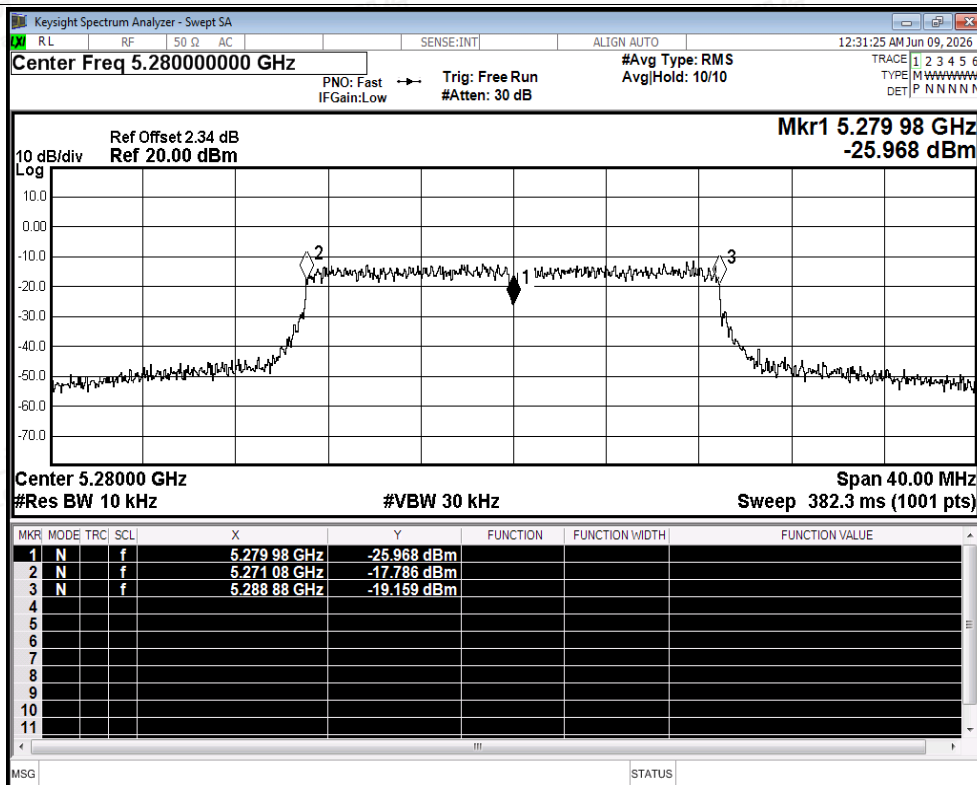

Freq. Stability NVNT n20 5280MHz Ant2

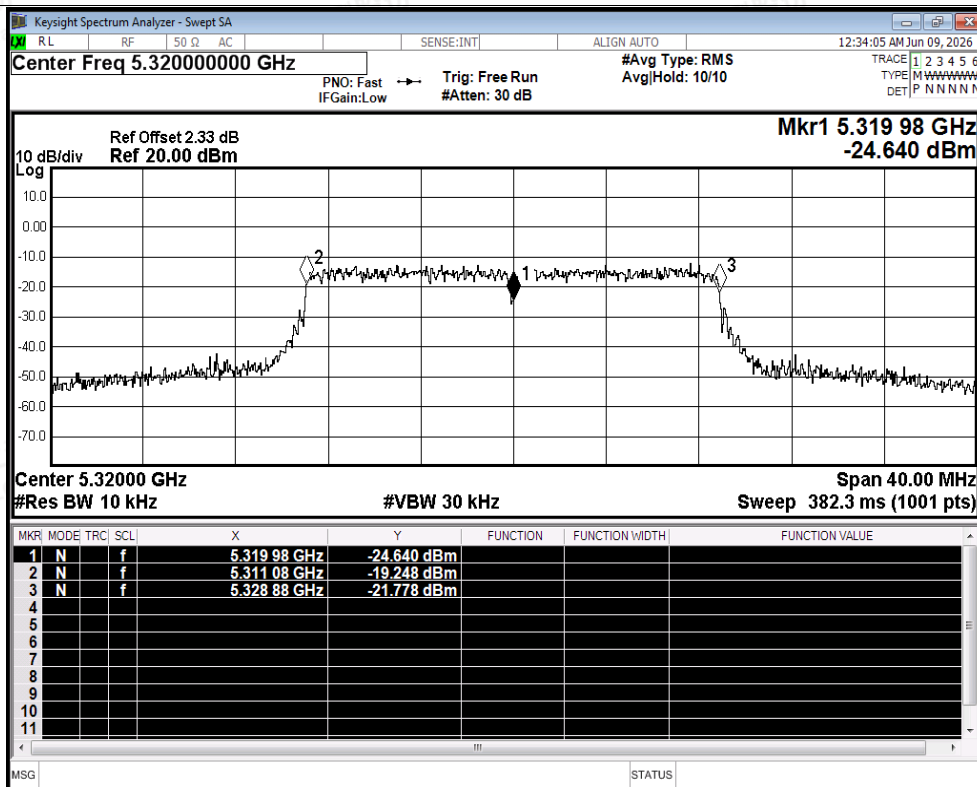

Freq. Stability NVNT n20 5320MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

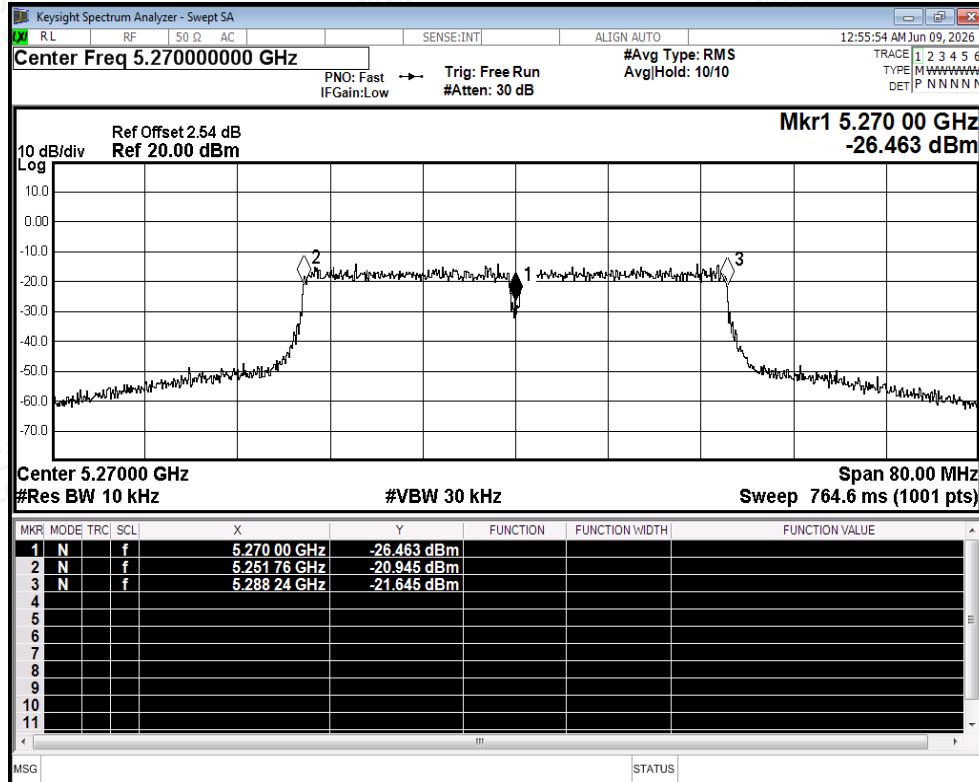

Freq. Stability NVNT n40 5270MHz Ant2

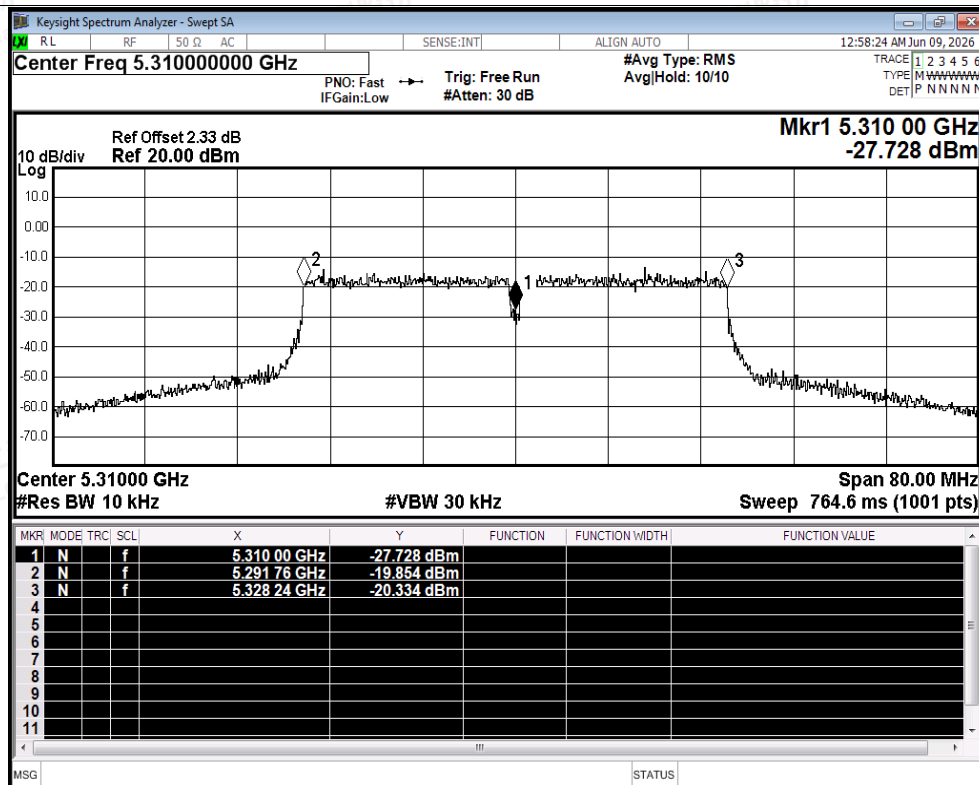

Freq. Stability NVNT n40 5310MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

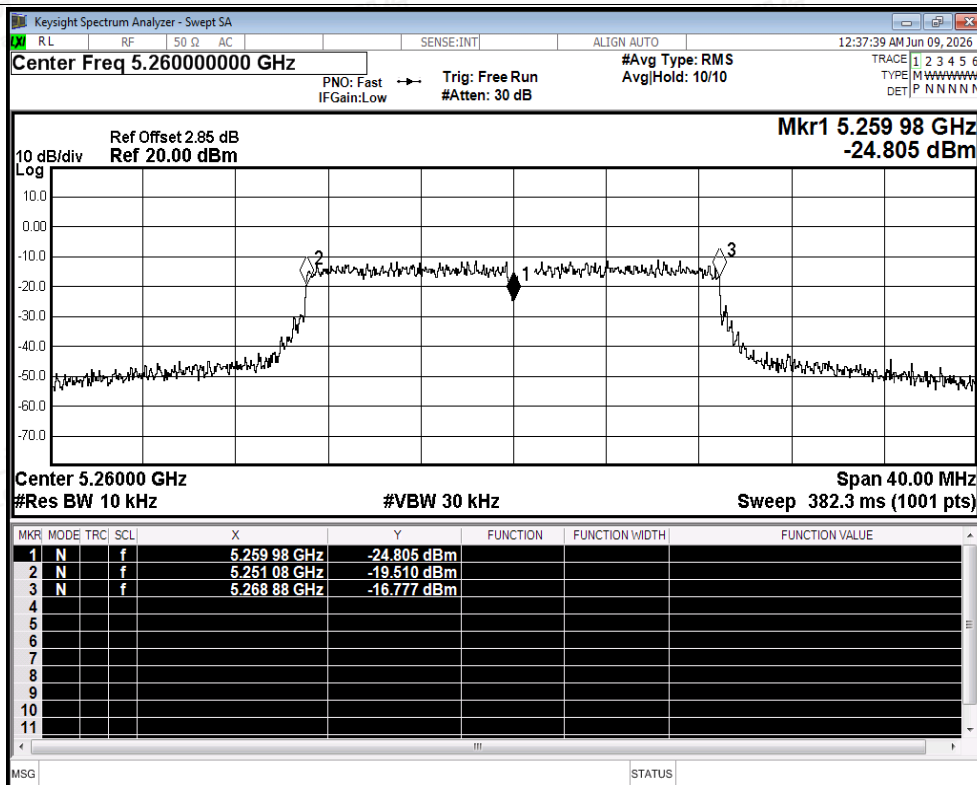

Freq. Stability NVNT ac20 5260MHz Ant2

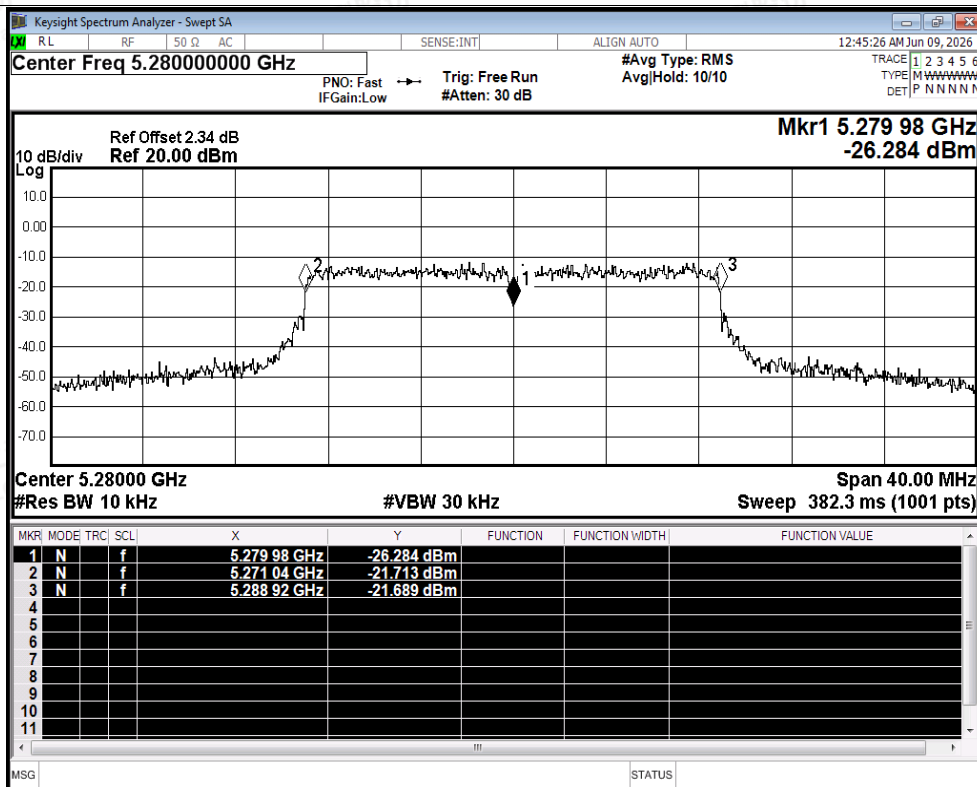

Freq. Stability NVNT ac20 5280MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

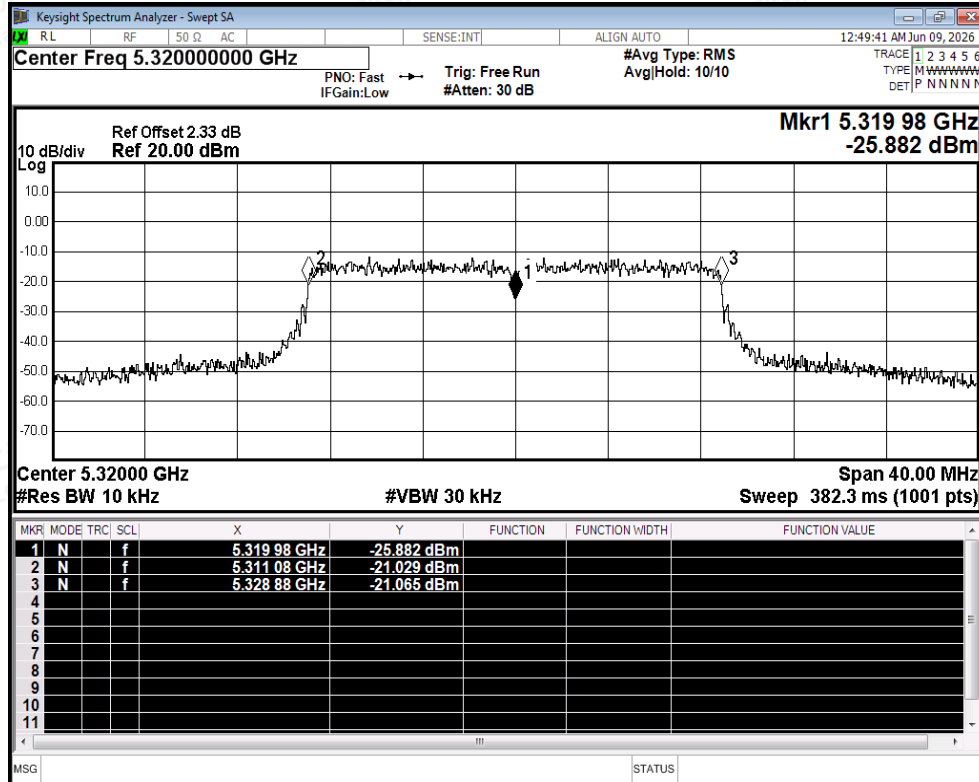

Freq. Stability NVNT ac20 5320MHz Ant2

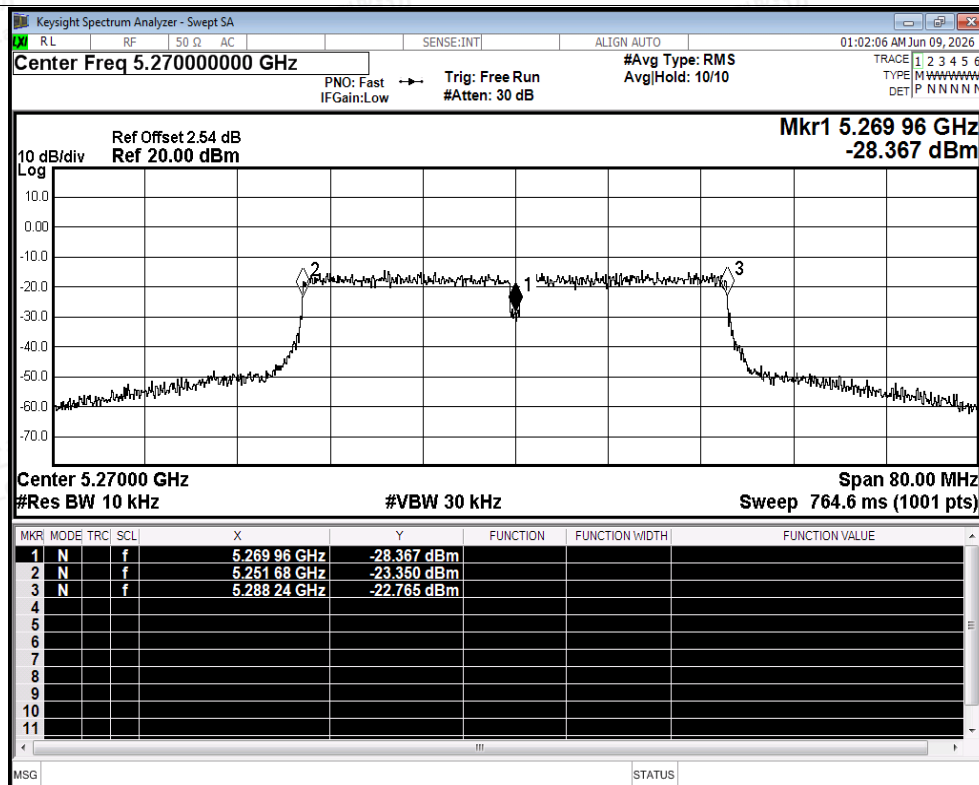

Freq. Stability NVNT ac40 5270MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

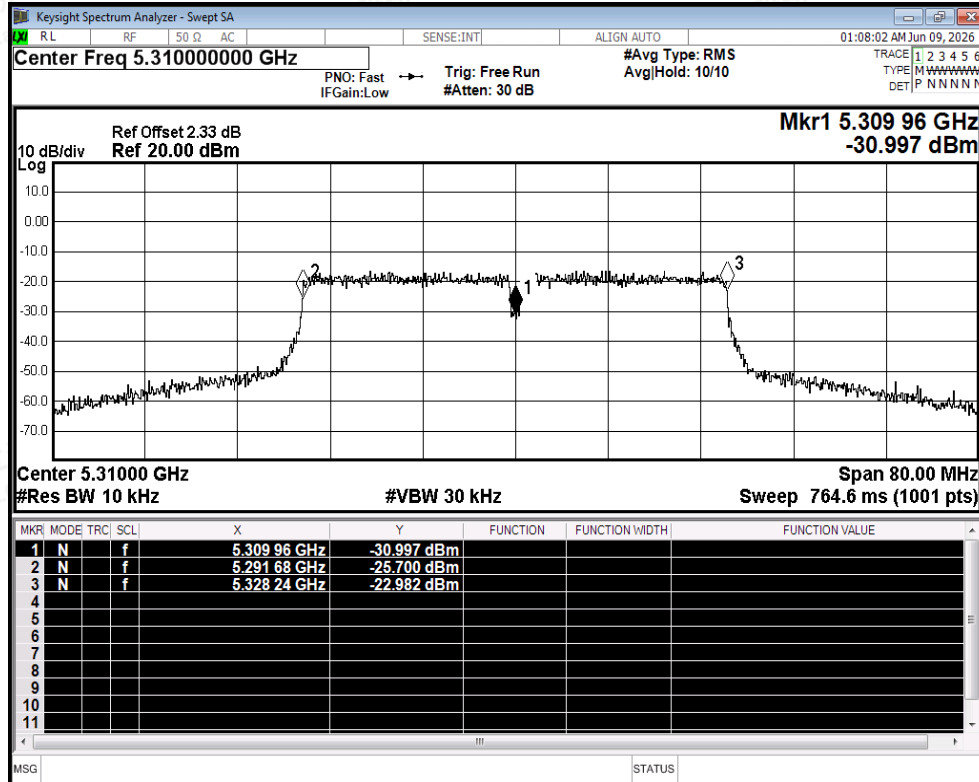

Freq. Stability NVNT ac40 5310MHz Ant2

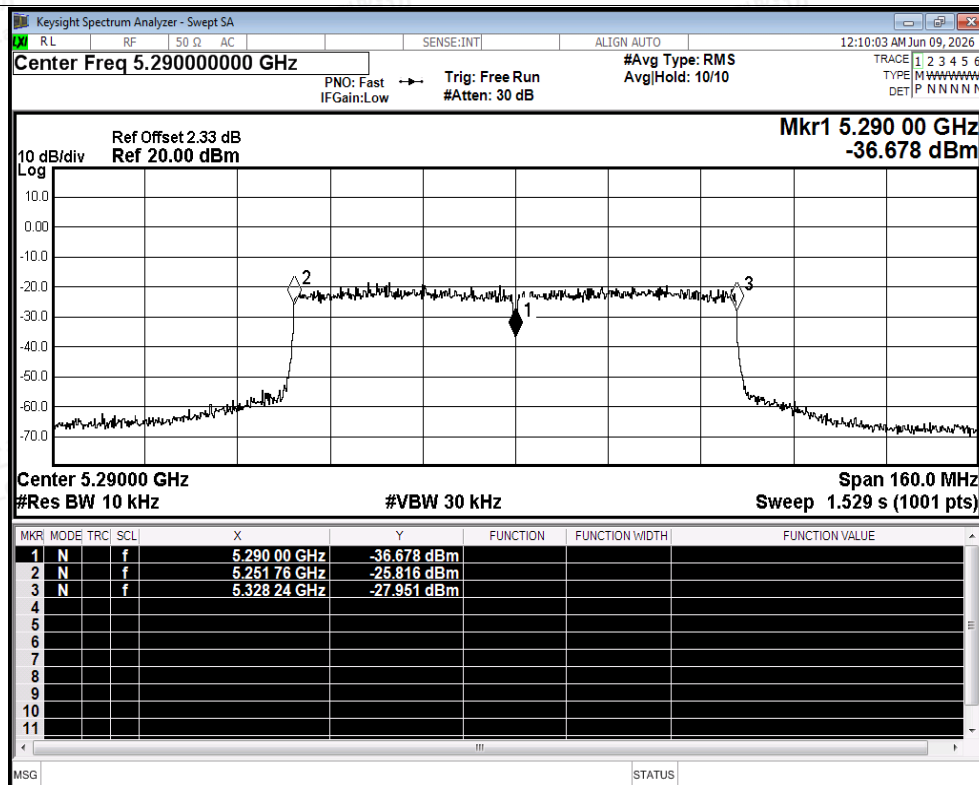

Freq. Stability NVNT ac80 5290MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

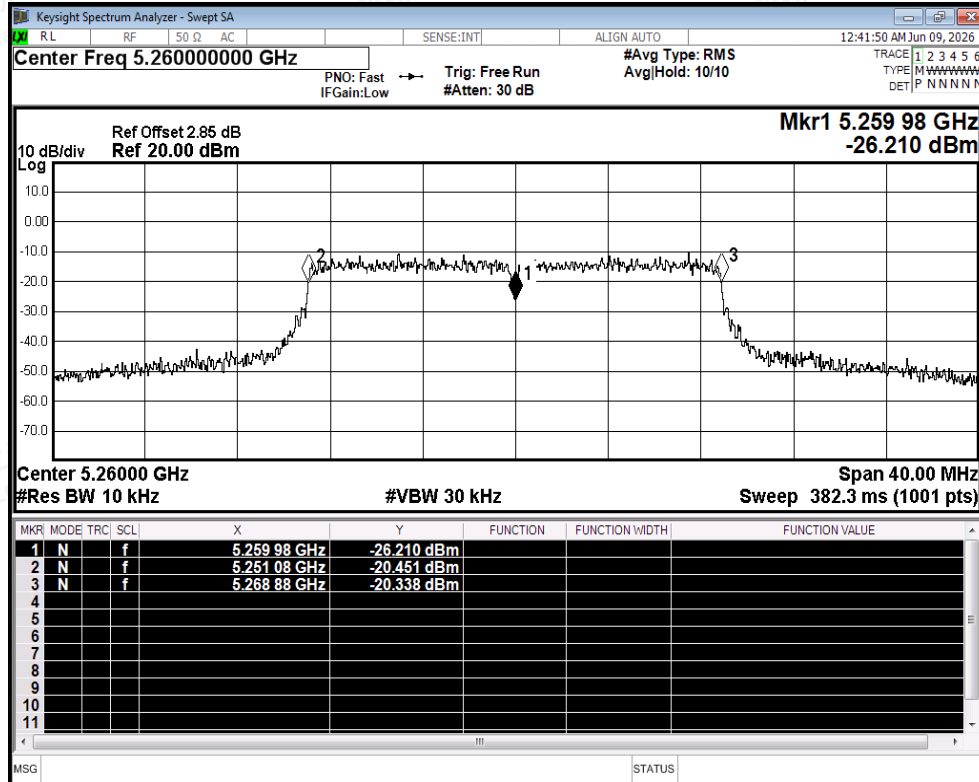

Freq. Stability NVNT ax20 5260MHz Ant2

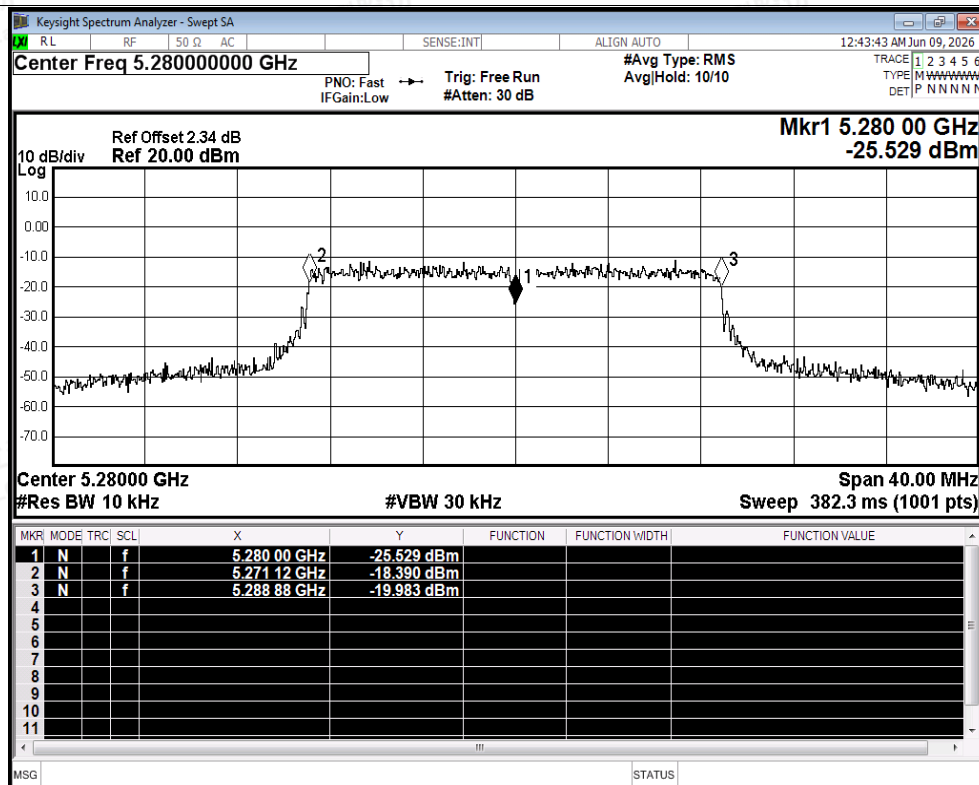

Freq. Stability NVNT ax20 5280MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

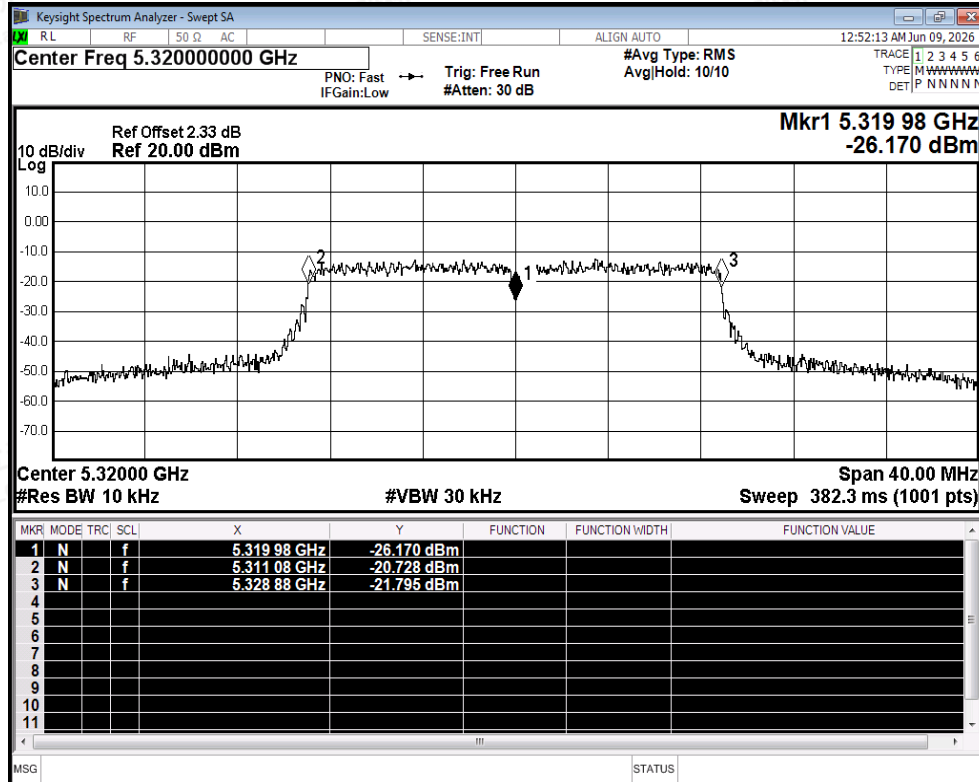

Freq. Stability NVNT ax20 5320MHz Ant2

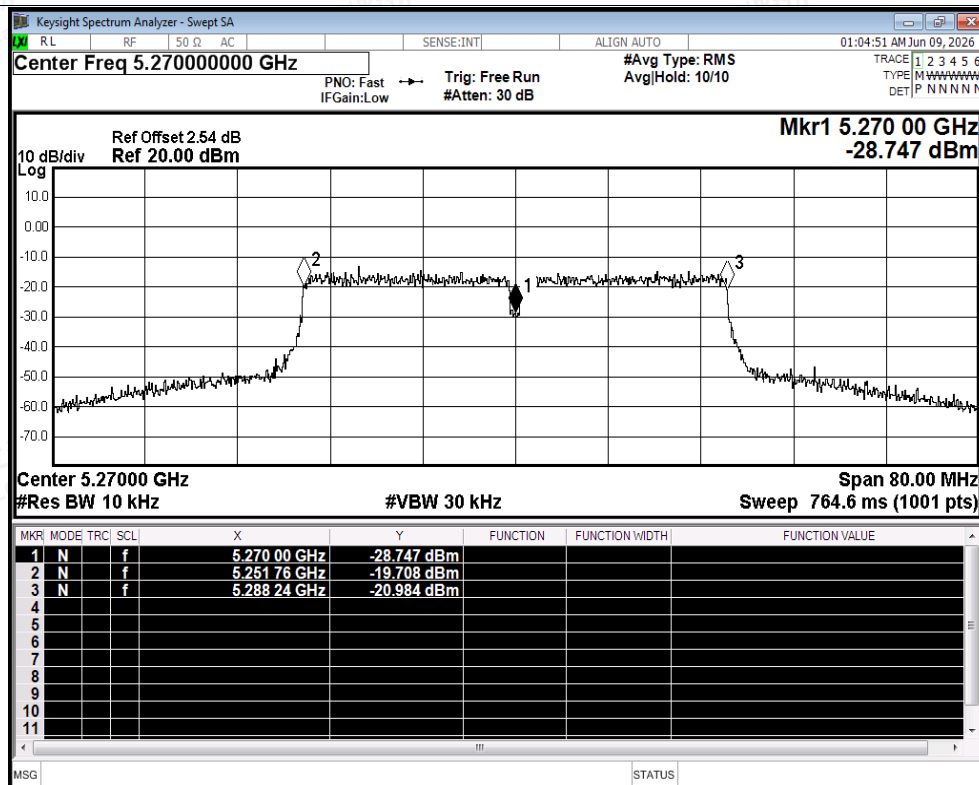

Freq. Stability NVNT ax40 5270MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

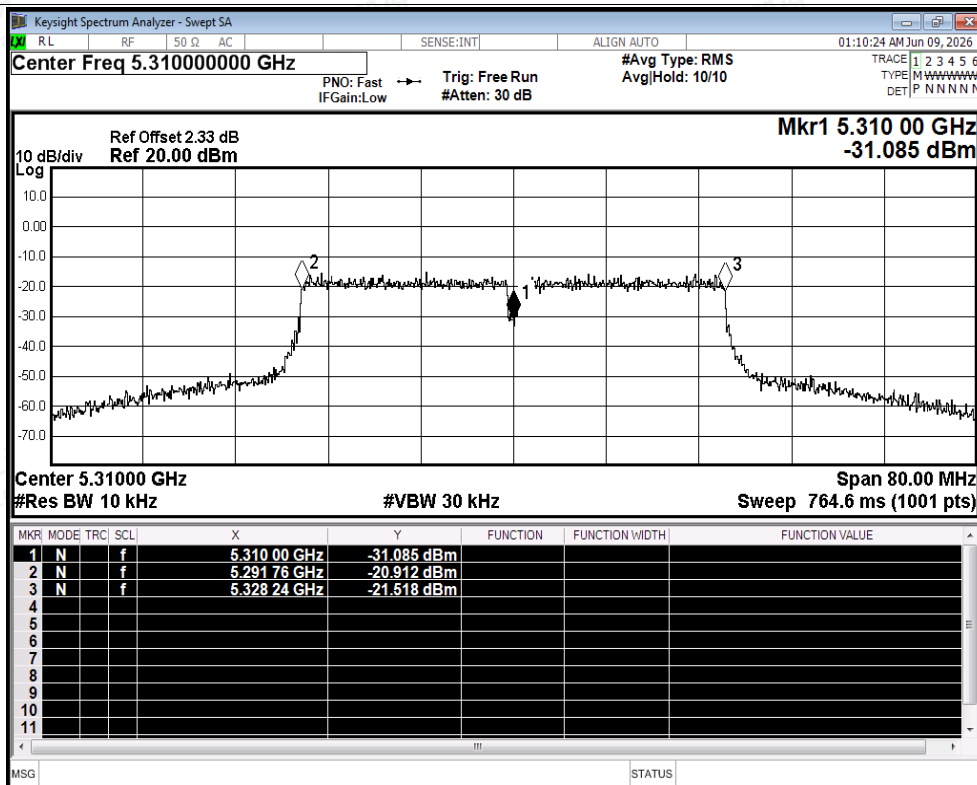

Freq. Stability NVNT ax40 5310MHz Ant2

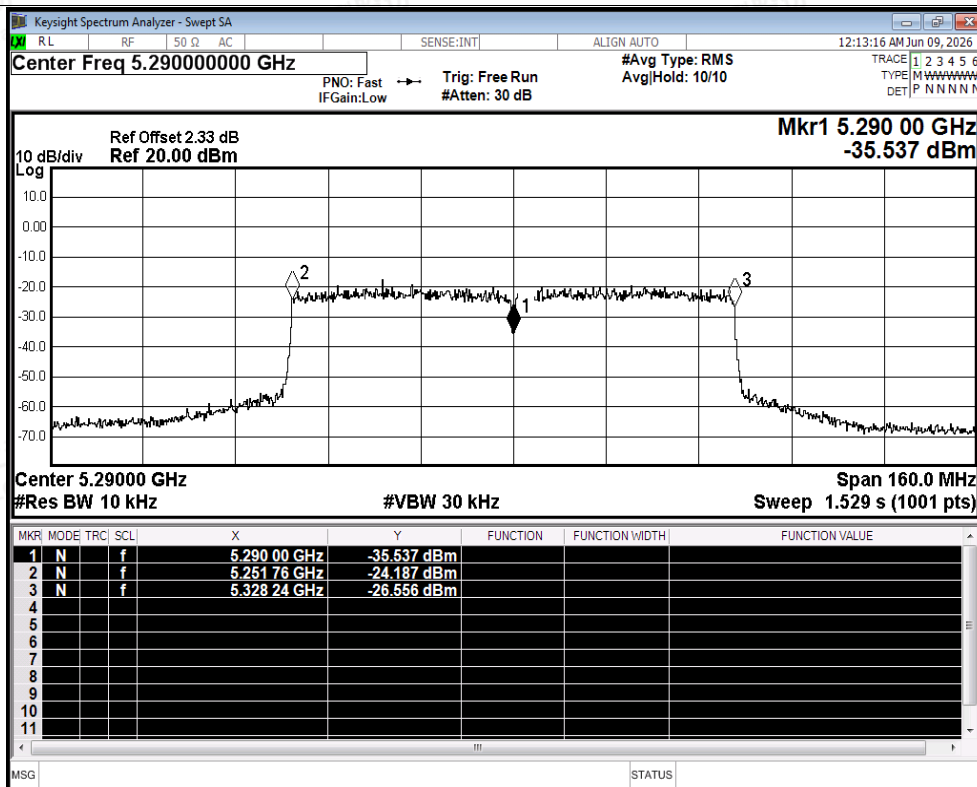

Freq. Stability NVNT ax80 5290MHz Ant2



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



E.6 Duty Cycle

Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5260	Ant1	97.46	0.11	0.37
NVNT	a	5280	Ant1	97.83	0.1	0.37
NVNT	a	5320	Ant1	97.83	0.1	0.37
NVNT	n20	5260	Ant1	97.41	0.11	0.44
NVNT	n20	5280	Ant1	97.41	0.11	0.44
NVNT	n20	5320	Ant1	97	0.13	0.44
NVNT	n40	5270	Ant1	94.87	0.23	0.9
NVNT	n40	5310	Ant1	94.87	0.23	0.9
NVNT	ac20	5260	Ant1	97.42	0.11	0.44
NVNT	ac20	5280	Ant1	97.42	0.11	0.44
NVNT	ac20	5320	Ant1	97.01	0.13	0.44
NVNT	ac40	5270	Ant1	94.92	0.23	0.89
NVNT	ac40	5310	Ant1	94.07	0.27	0.9
NVNT	ac80	5290	Ant1	90	0.46	1.85
NVNT	ax20	5260	Ant1	97.42	0.11	0.44
NVNT	ax20	5280	Ant1	97	0.13	0.44
NVNT	ax20	5320	Ant1	97.42	0.11	0.44
NVNT	ax40	5270	Ant1	94.87	0.23	0.9
NVNT	ax40	5310	Ant1	94.87	0.23	0.9
NVNT	ax80	5290	Ant1	90	0.46	1.85




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

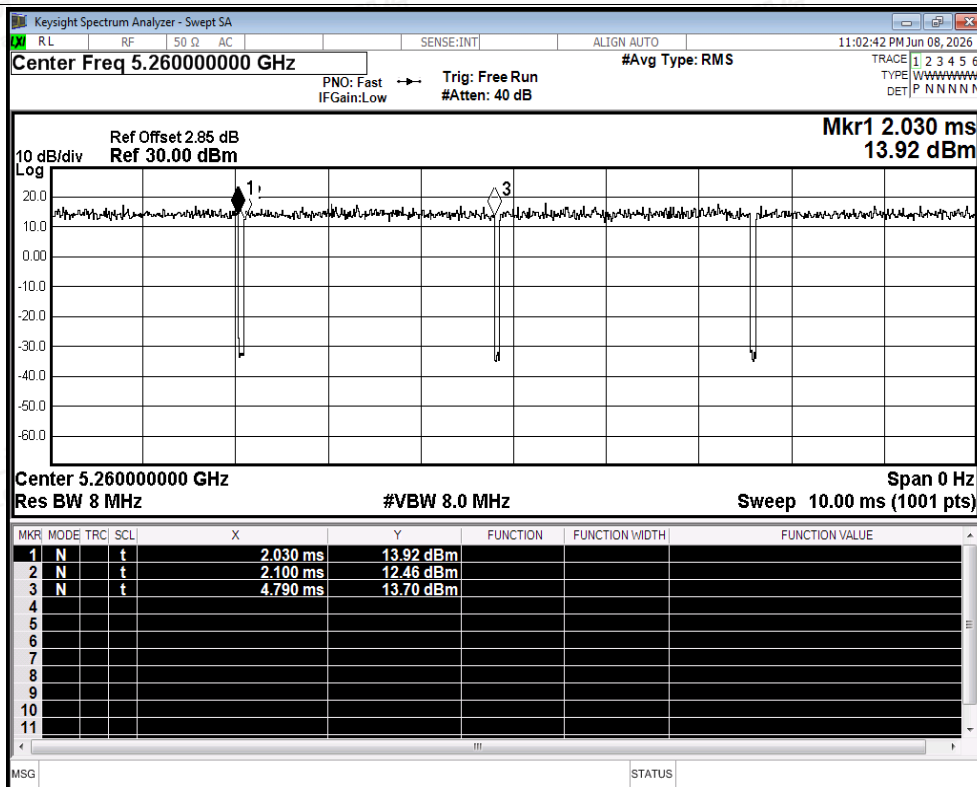

Duty Cycle NVNT a 5260MHz Ant1

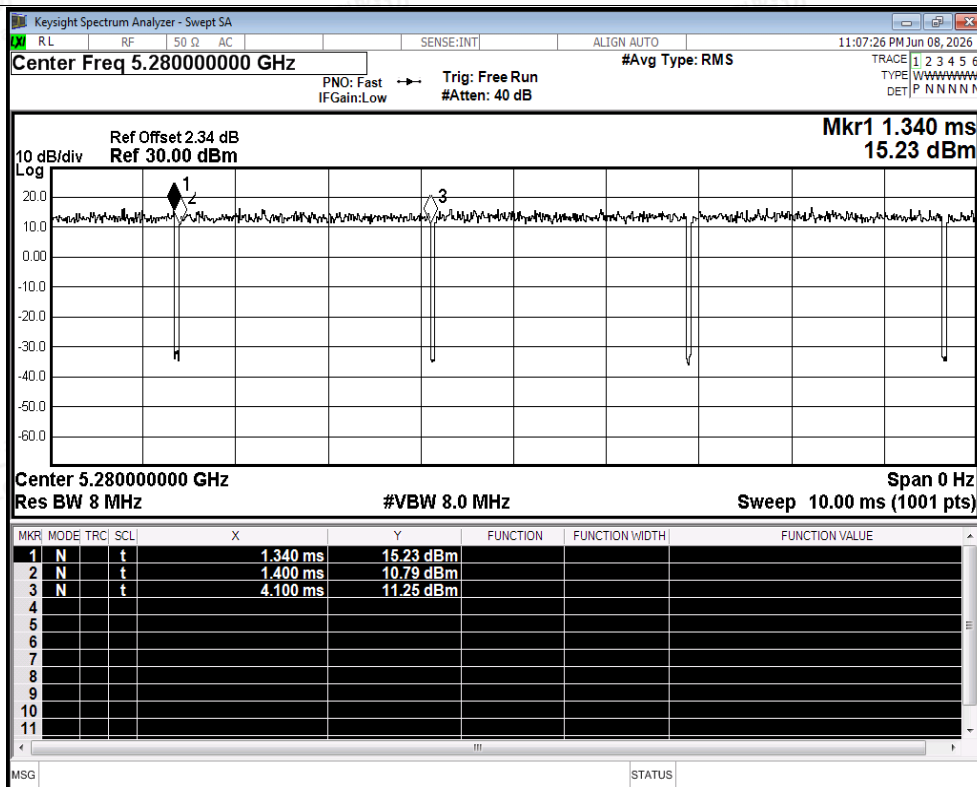

Duty Cycle NVNT a 5280MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

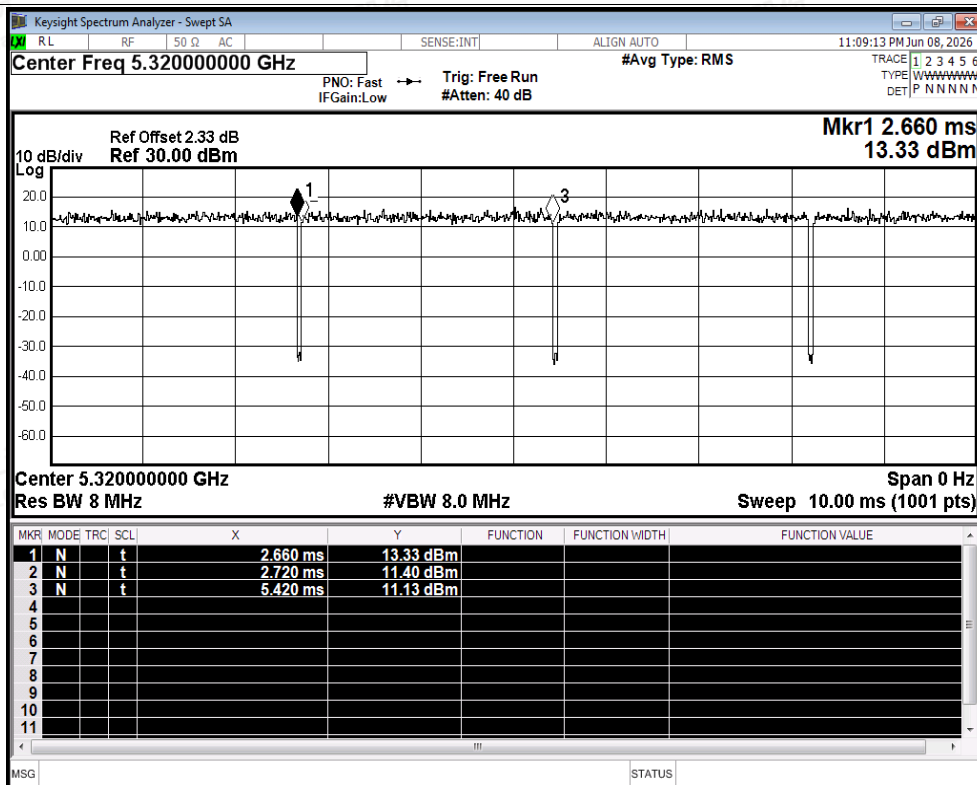

Duty Cycle NVNT a 5320MHz Ant1

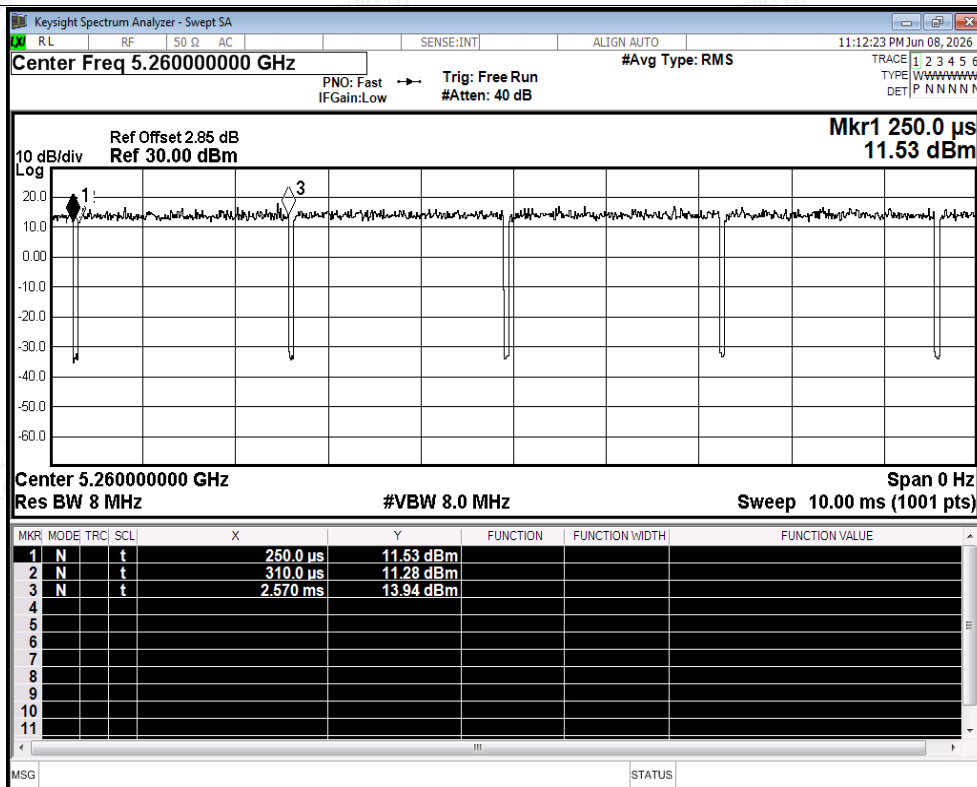

Duty Cycle NVNT n20 5260MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

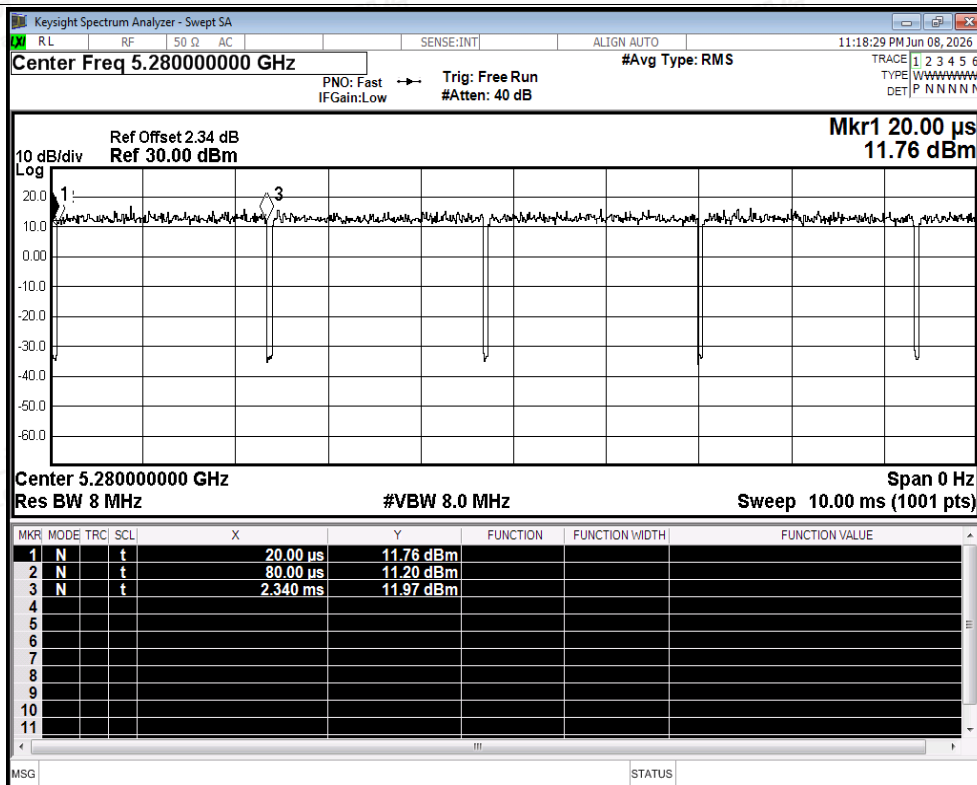

Duty Cycle NVNT n20 5280MHz Ant1

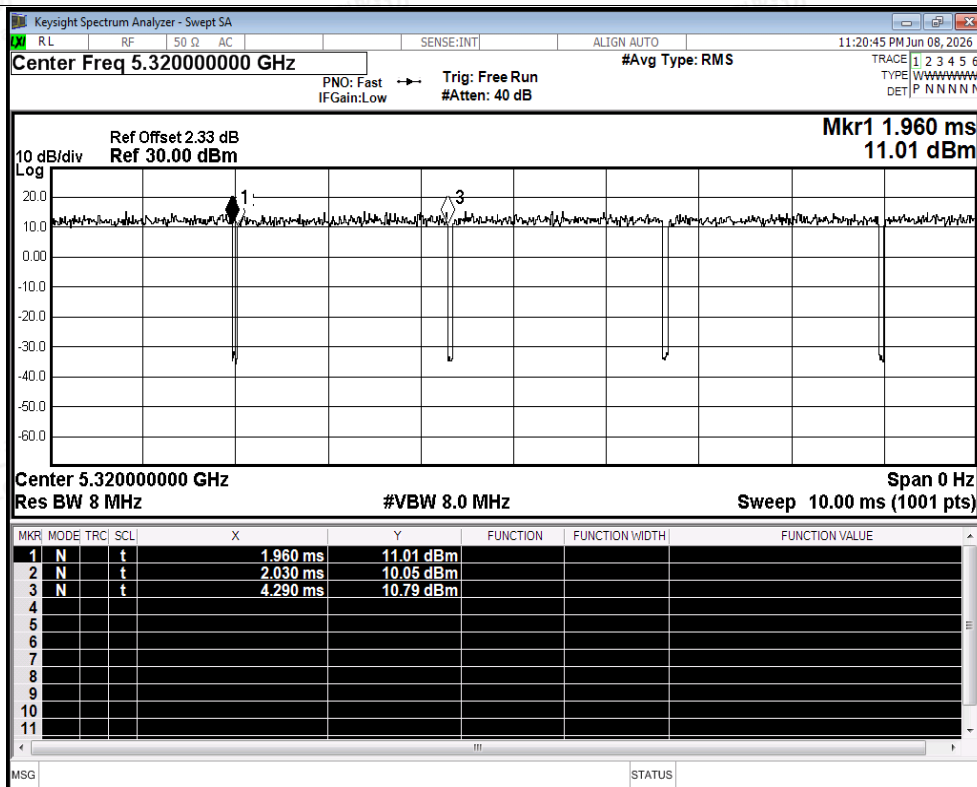

Duty Cycle NVNT n20 5320MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

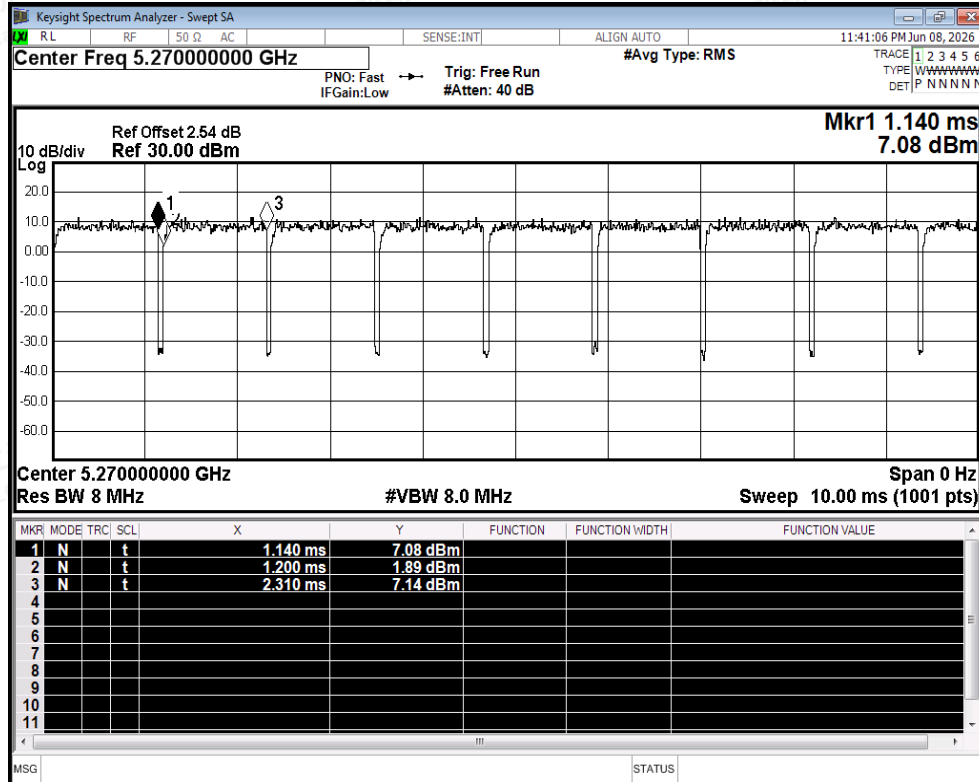

Duty Cycle NVNT n40 5270MHz Ant1

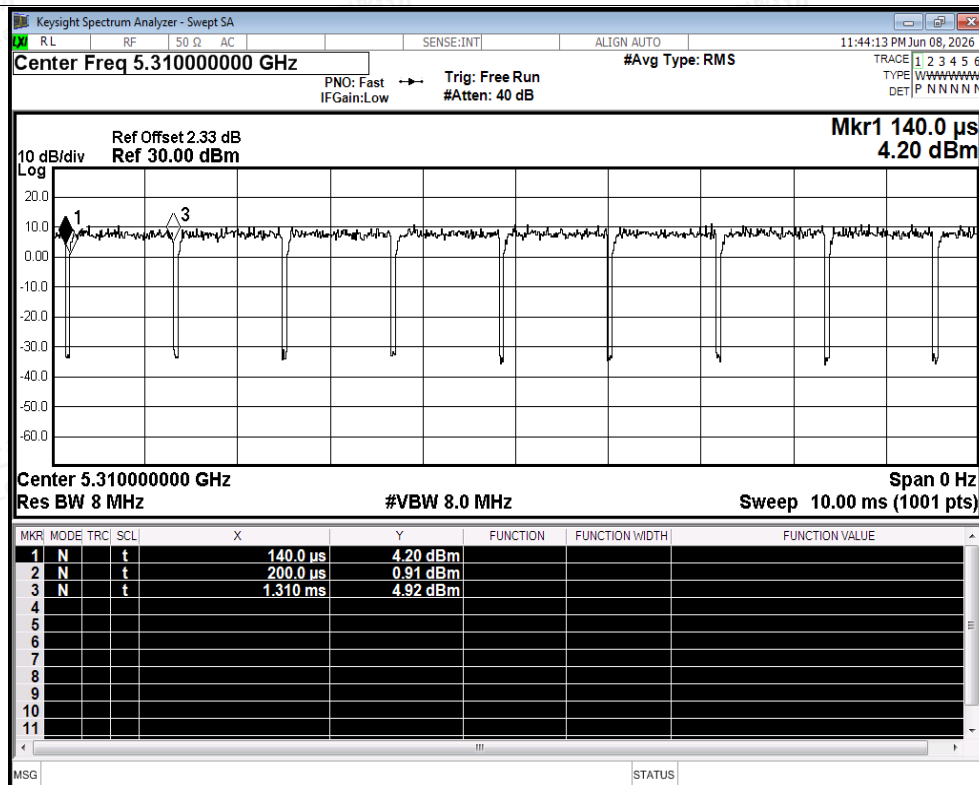

Duty Cycle NVNT n40 5310MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

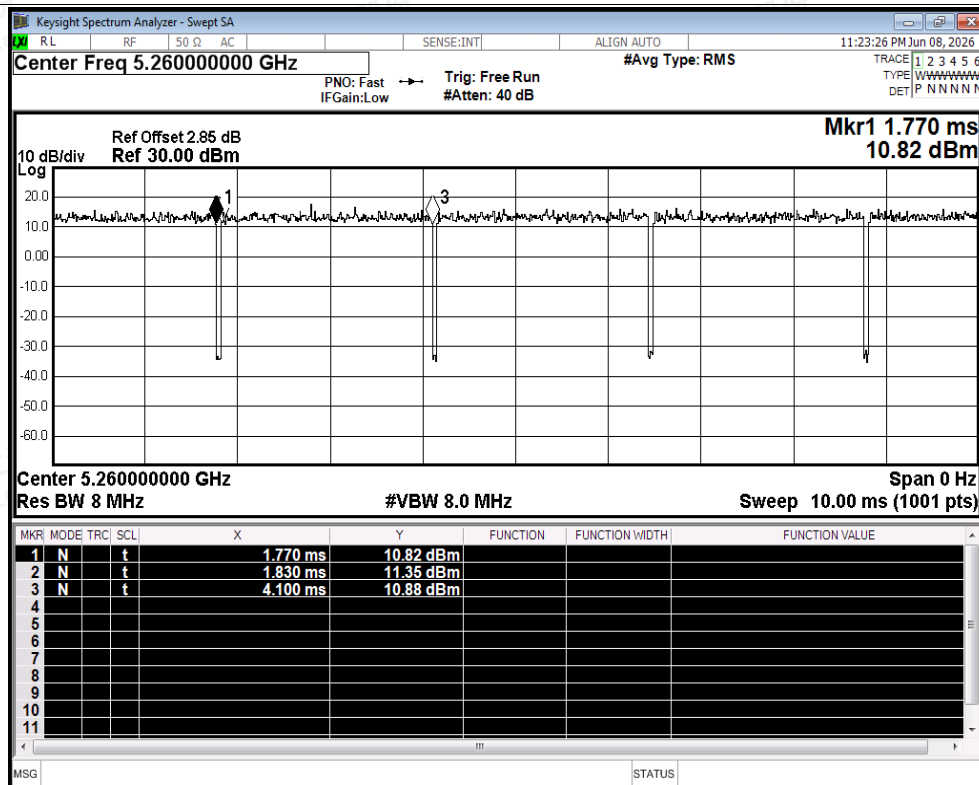

Duty Cycle NVNT ac20 5260MHz Ant1

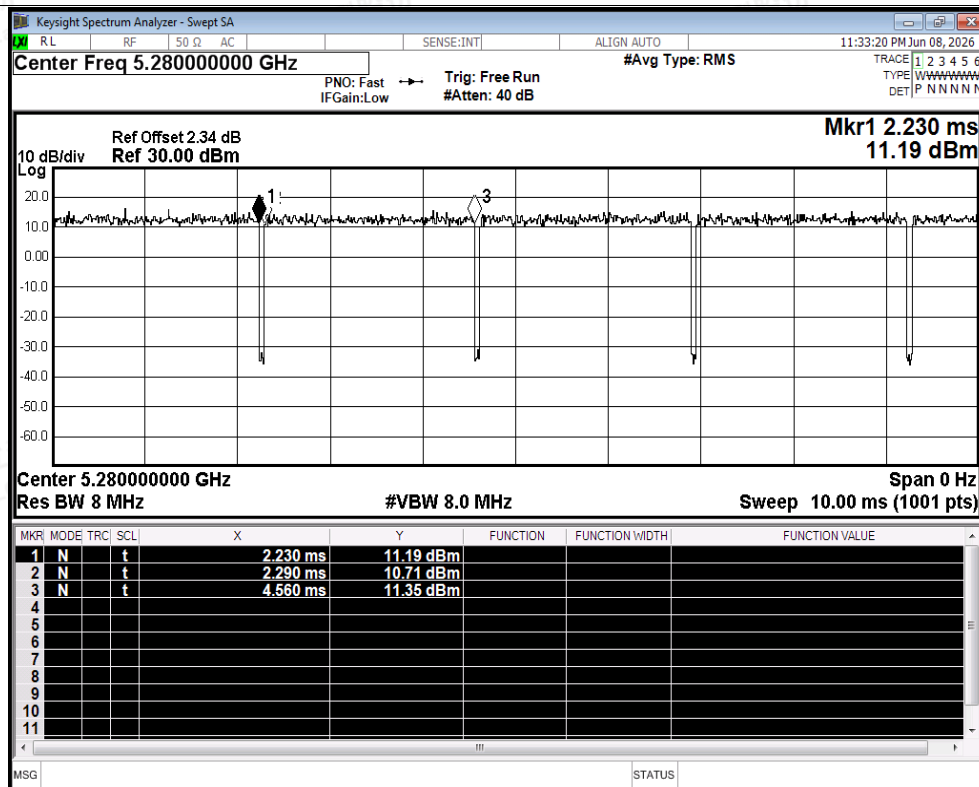

Duty Cycle NVNT ac20 5280MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

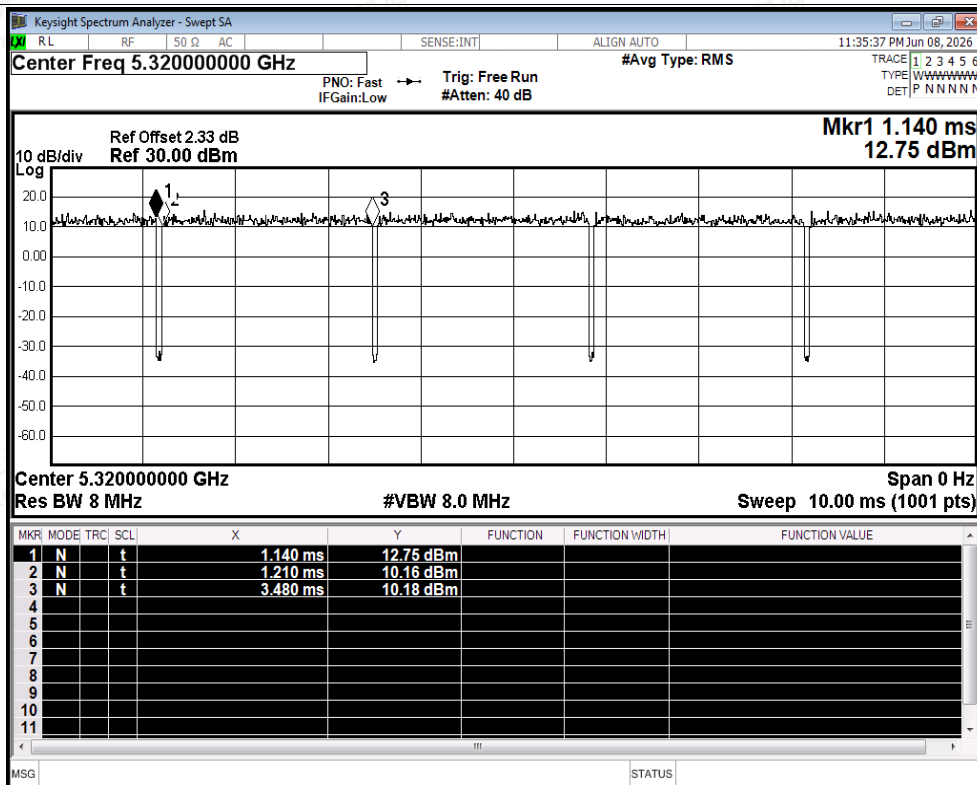

Duty Cycle NVNT ac20 5320MHz Ant1

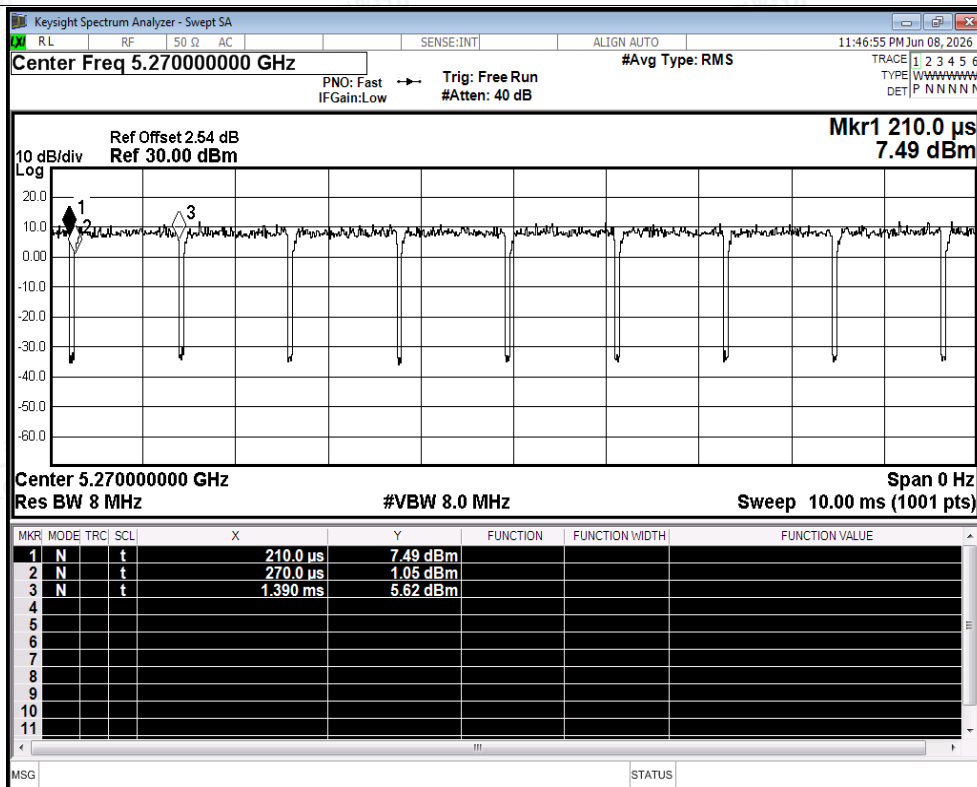

Duty Cycle NVNT ac40 5270MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

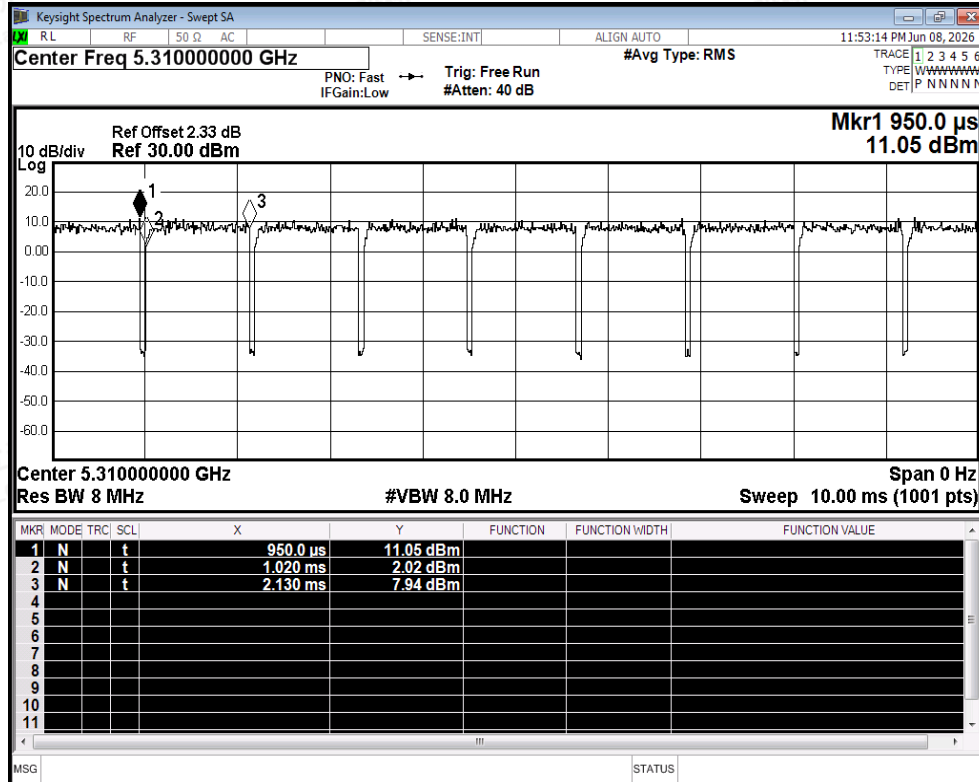

Duty Cycle NVNT ac40 5310MHz Ant1

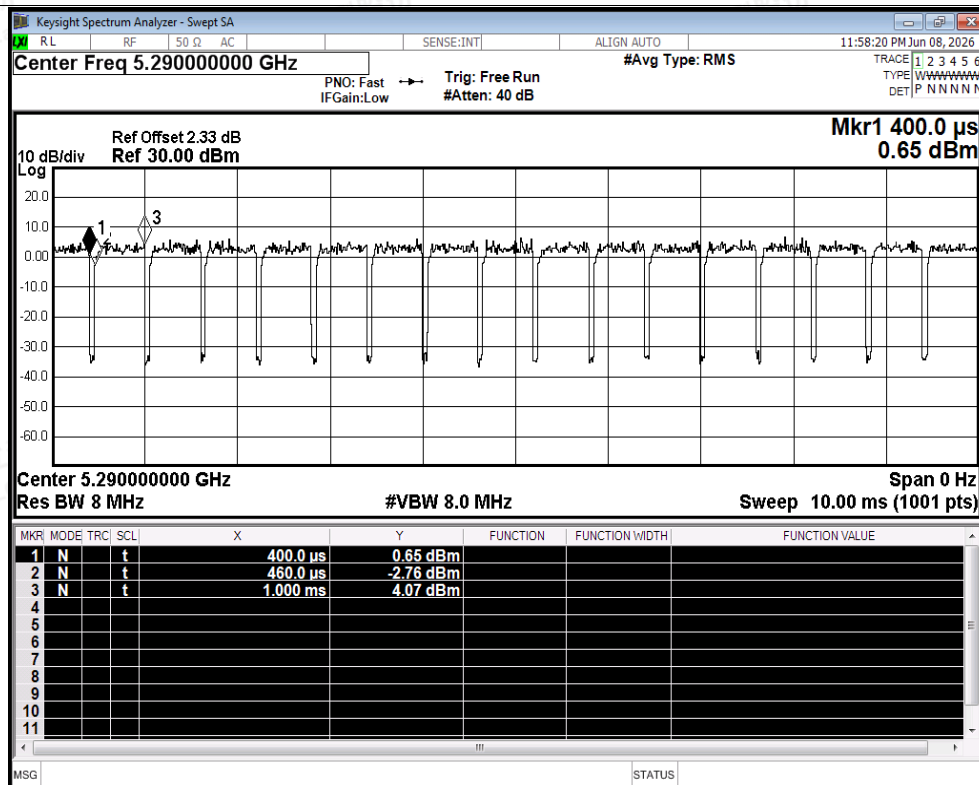

Duty Cycle NVNT ac80 5290MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

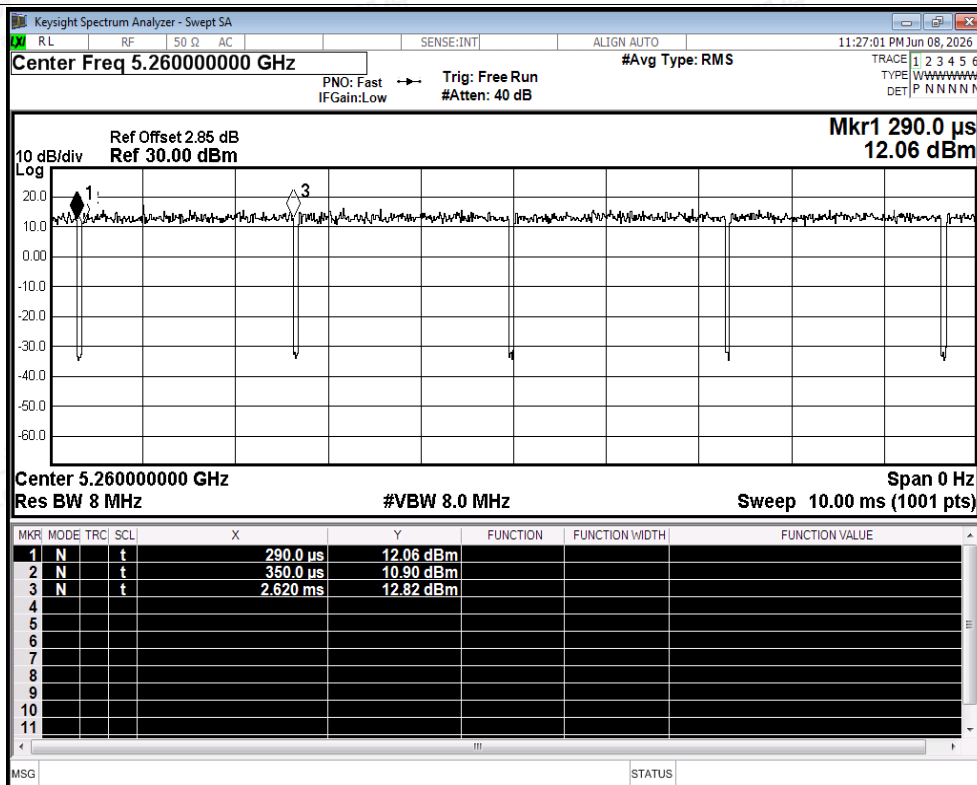

Duty Cycle NVNT ax20 5260MHz Ant1

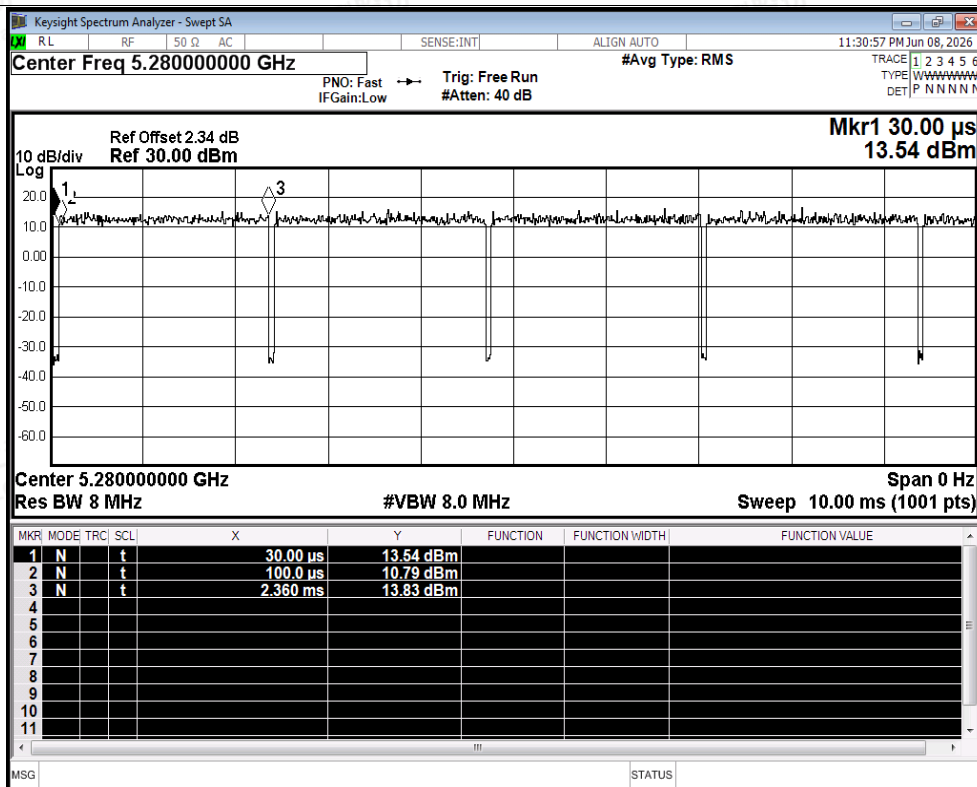

Duty Cycle NVNT ax20 5280MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

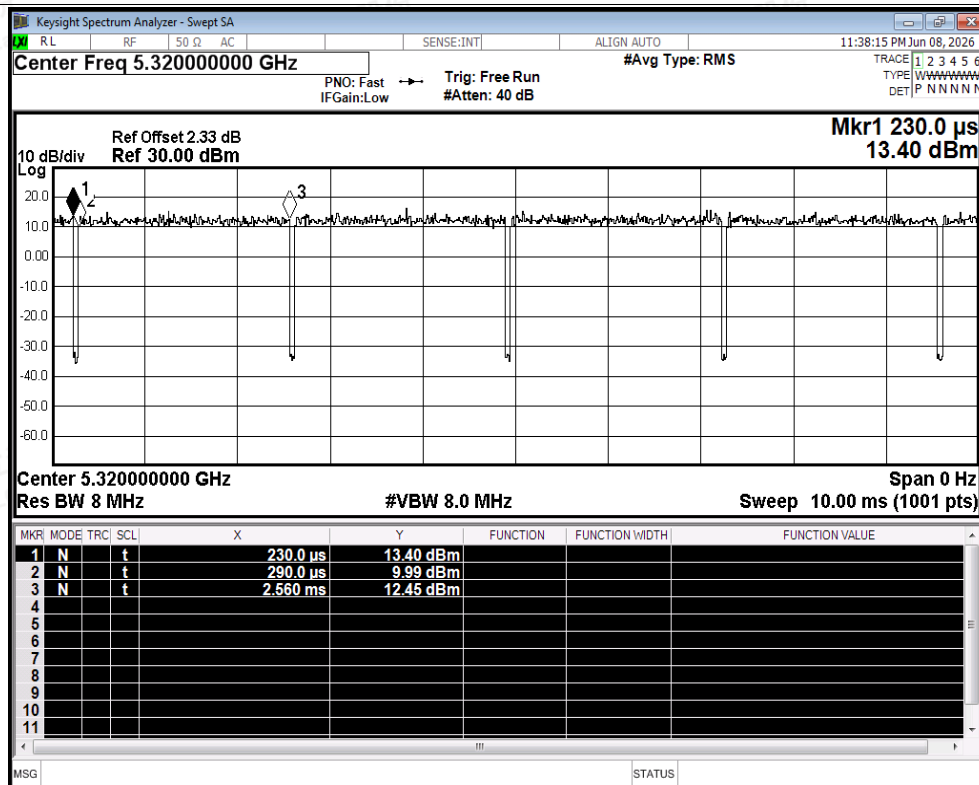

Duty Cycle NVNT ax20 5320MHz Ant1

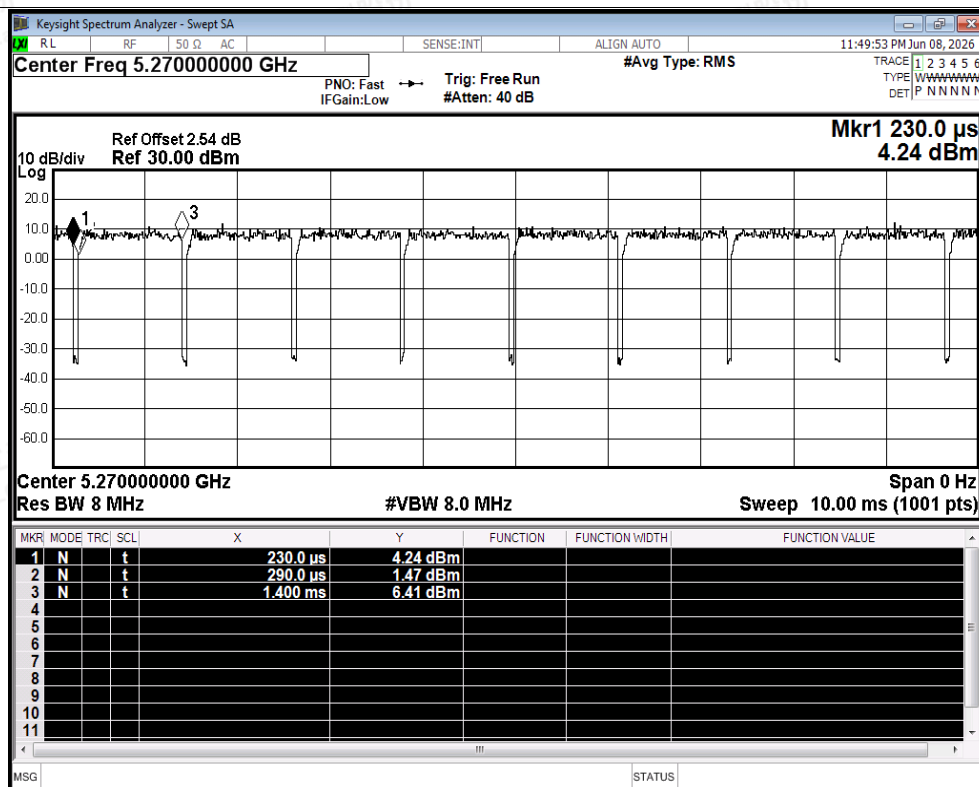

Duty Cycle NVNT ax40 5270MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

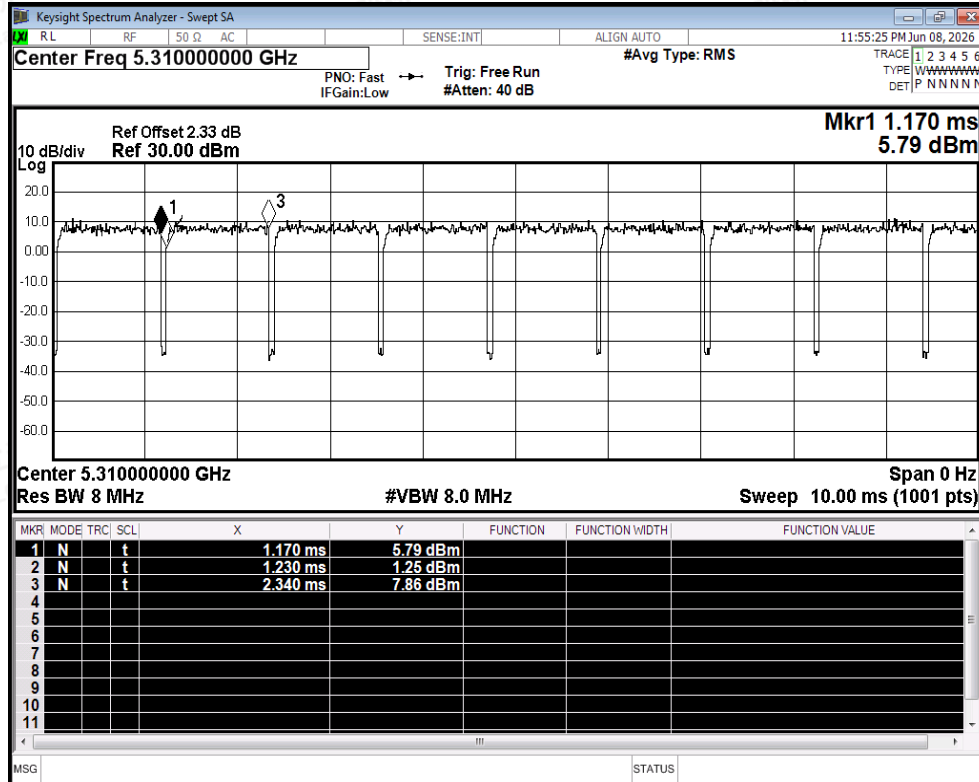

Duty Cycle NVNT ax40 5310MHz Ant1

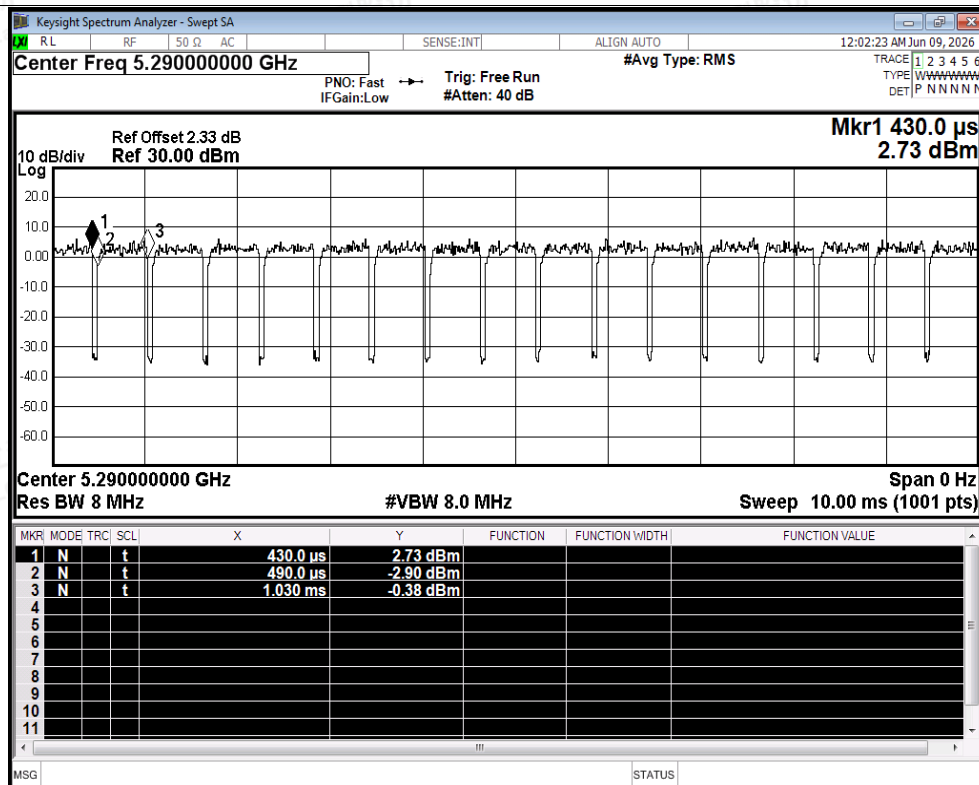

Duty Cycle NVNT ax80 5290MHz Ant1



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5260	Ant2	97.46	0.11	0.37
NVNT	a	5280	Ant2	97.83	0.1	0.37
NVNT	a	5320	Ant2	97.83	0.1	0.37
NVNT	n20	5260	Ant2	97.41	0.11	0.44
NVNT	n20	5280	Ant2	97	0.13	0.44
NVNT	n20	5320	Ant2	97.41	0.11	0.44
NVNT	n40	5270	Ant2	94.87	0.23	0.9
NVNT	n40	5310	Ant2	94.02	0.27	0.91
NVNT	ac20	5260	Ant2	97.42	0.11	0.44
NVNT	ac20	5280	Ant2	97.42	0.11	0.44
NVNT	ac20	5320	Ant2	97.42	0.11	0.44
NVNT	ac40	5270	Ant2	94.87	0.23	0.9
NVNT	ac40	5310	Ant2	94.87	0.23	0.9
NVNT	ac80	5290	Ant2	90	0.46	1.85
NVNT	ax20	5260	Ant2	97	0.13	0.44
NVNT	ax20	5280	Ant2	97	0.13	0.44
NVNT	ax20	5320	Ant2	97	0.13	0.44
NVNT	ax40	5270	Ant2	94.87	0.23	0.9
NVNT	ax40	5310	Ant2	94.87	0.23	0.9
NVNT	ax80	5290	Ant2	90	0.46	1.85




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

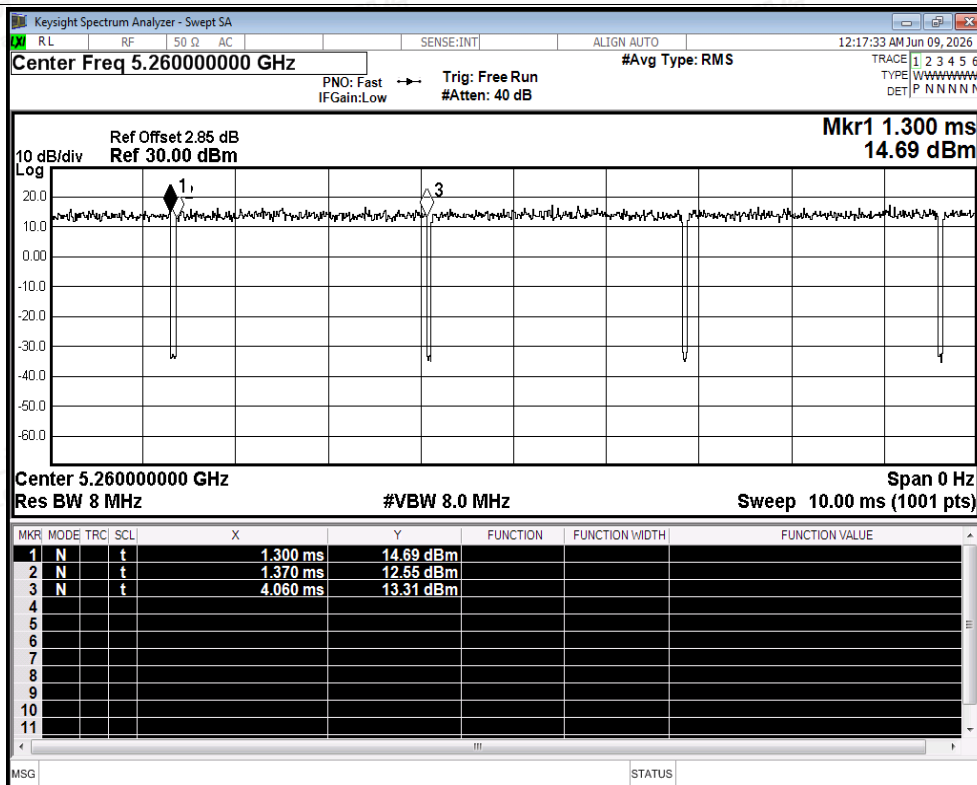

Duty Cycle NVNT a 5260MHz Ant2

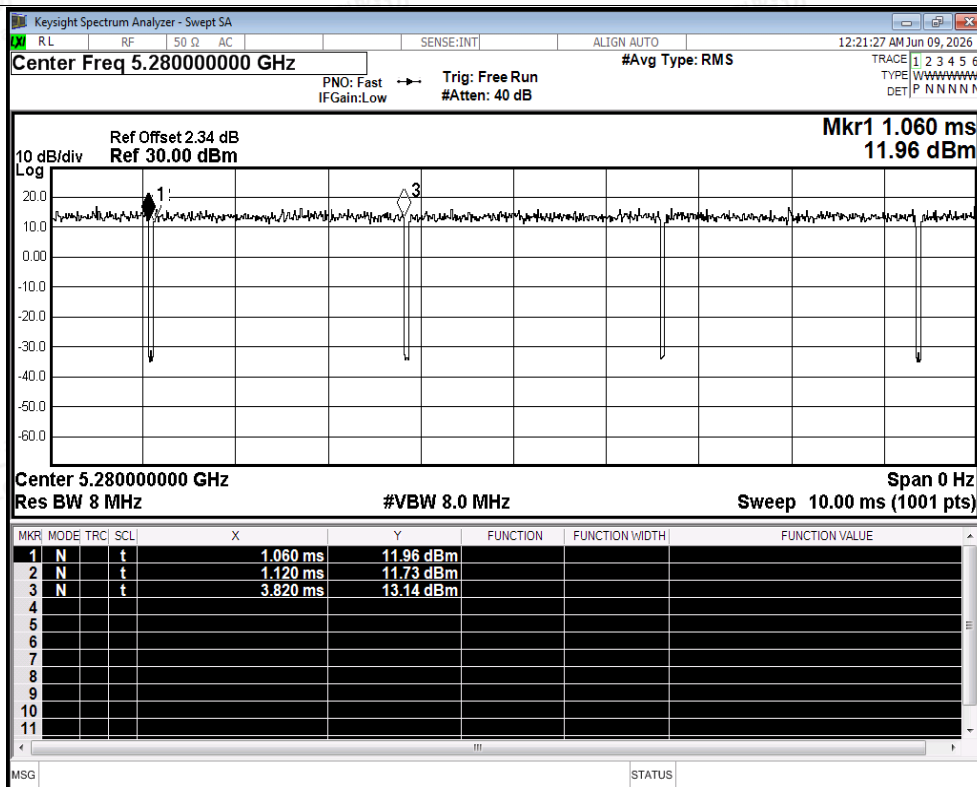

Duty Cycle NVNT a 5280MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

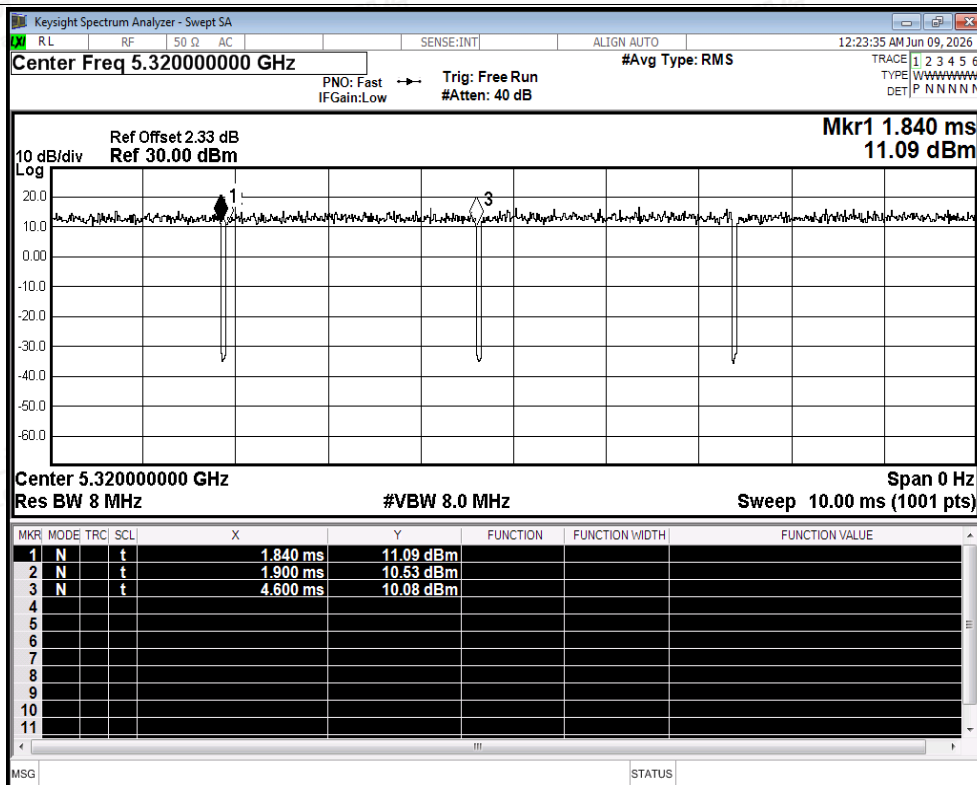

Duty Cycle NVNT a 5320MHz Ant2

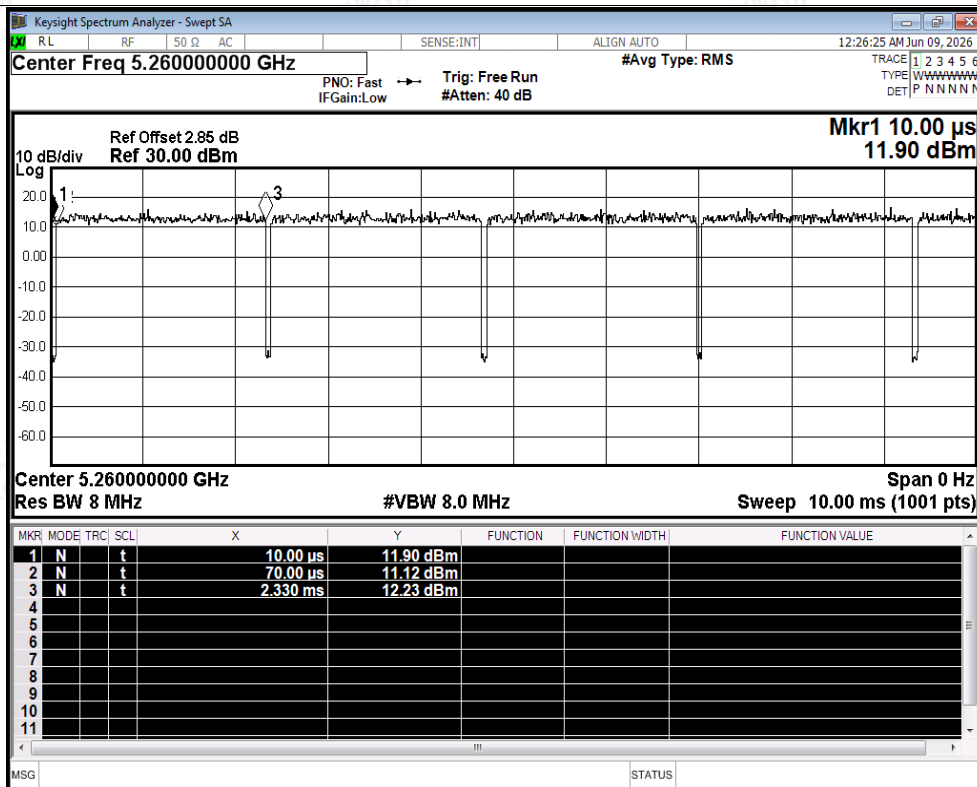

Duty Cycle NVNT n20 5260MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

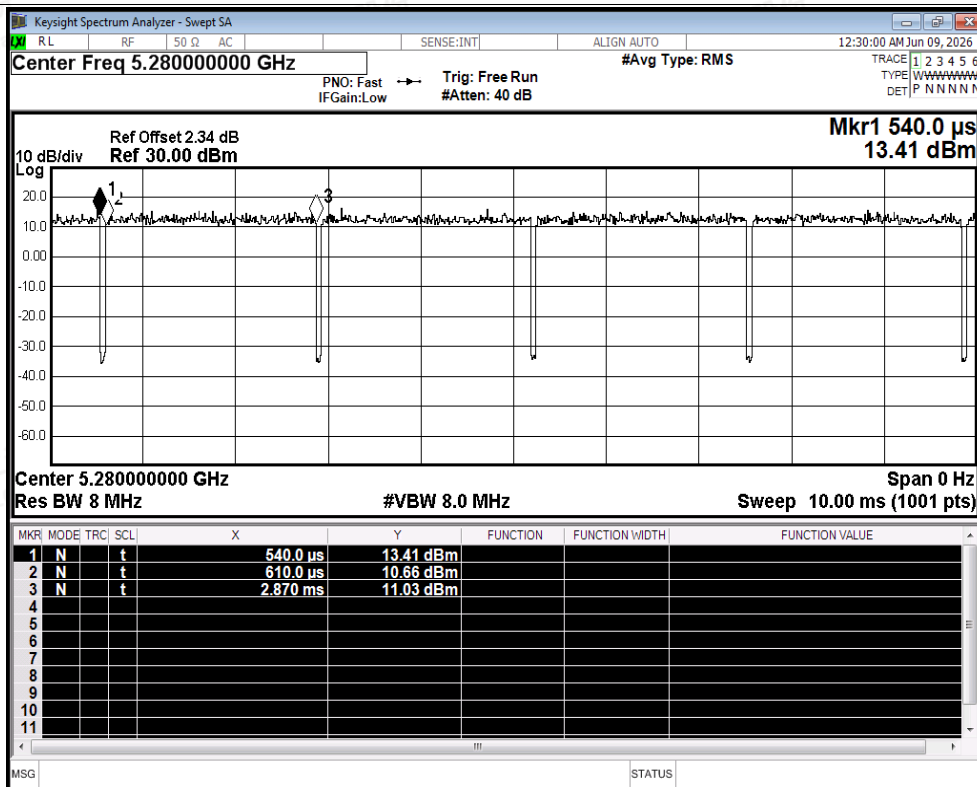

Duty Cycle NVNT n20 5280MHz Ant2

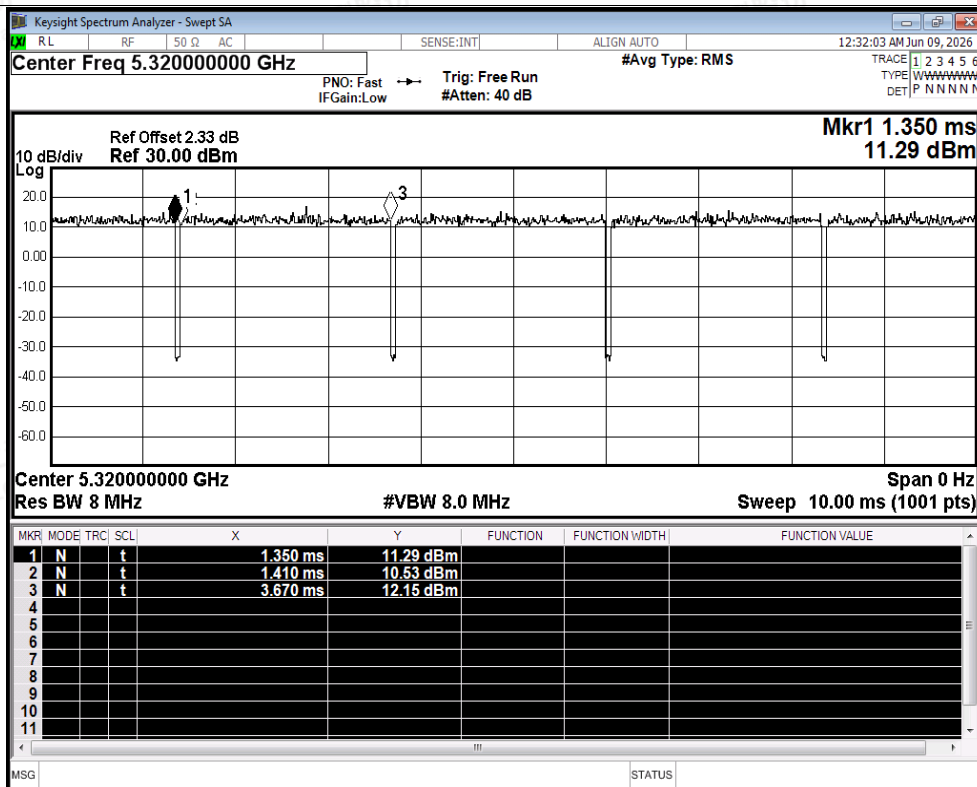

Duty Cycle NVNT n20 5320MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

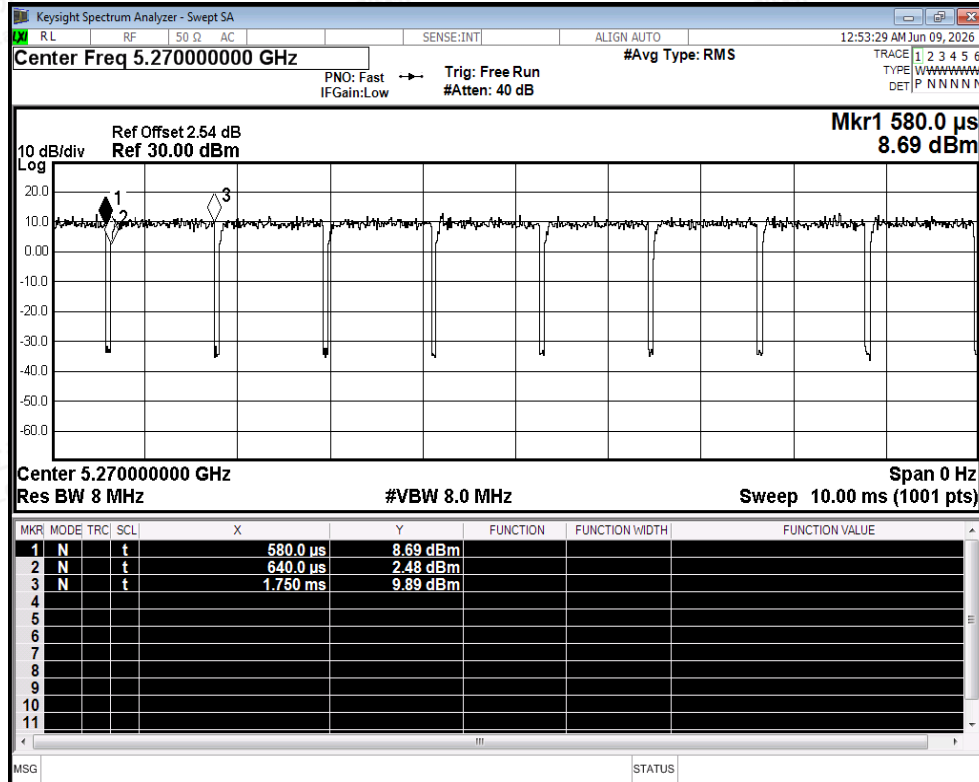

Duty Cycle NVNT n40 5270MHz Ant2

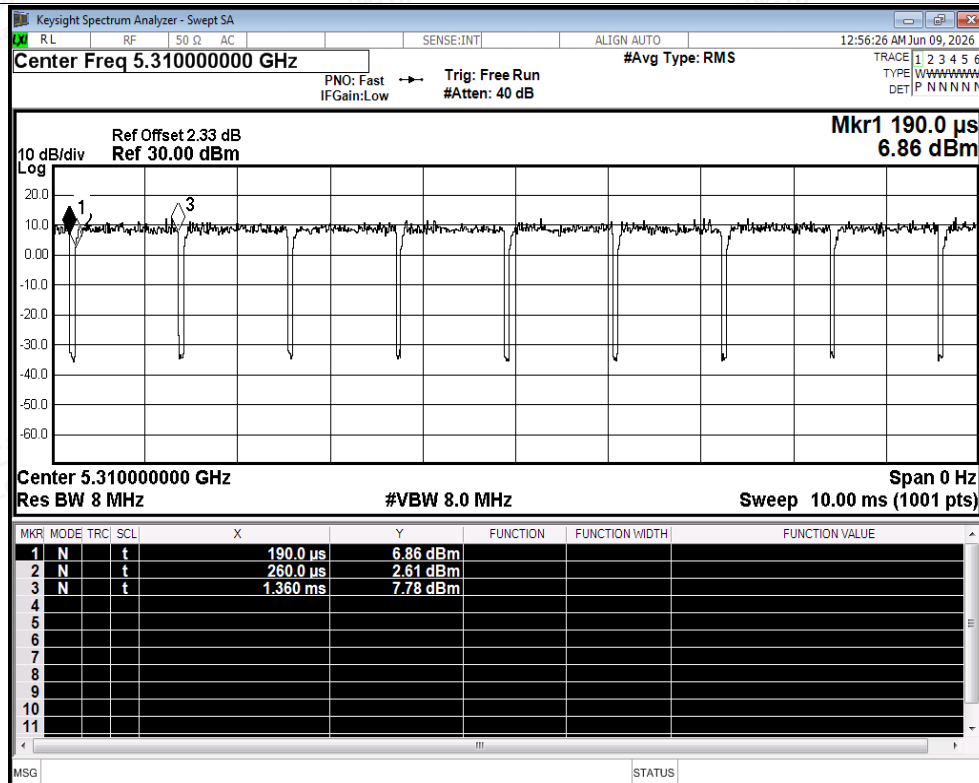

Duty Cycle NVNT n40 5310MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

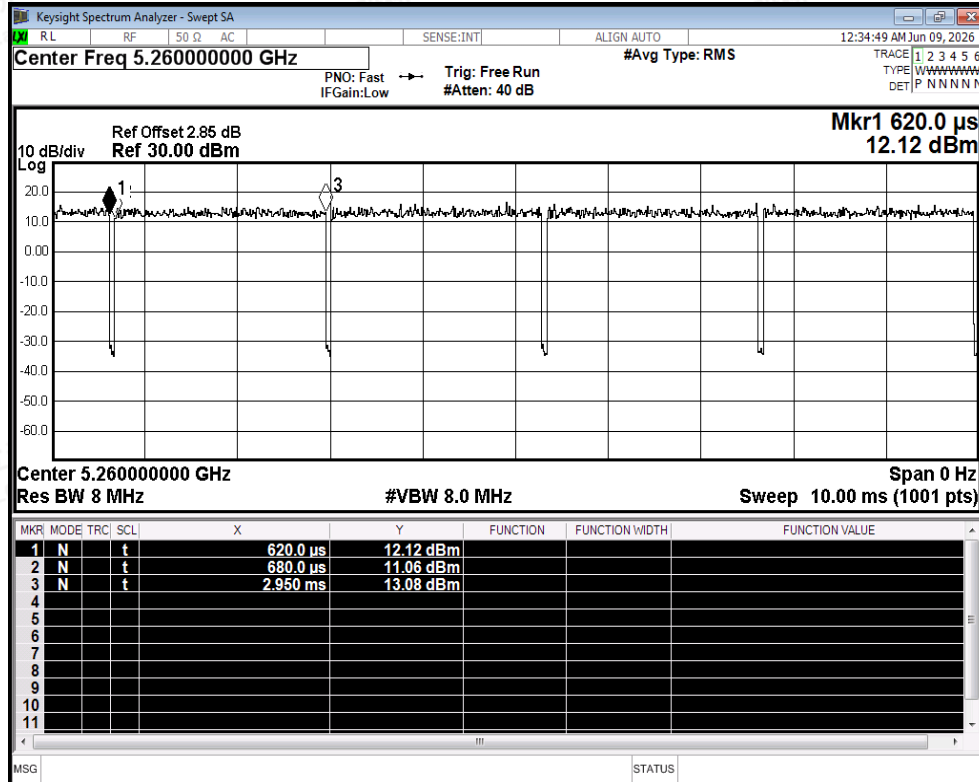

Duty Cycle NVNT ac20 5260MHz Ant2

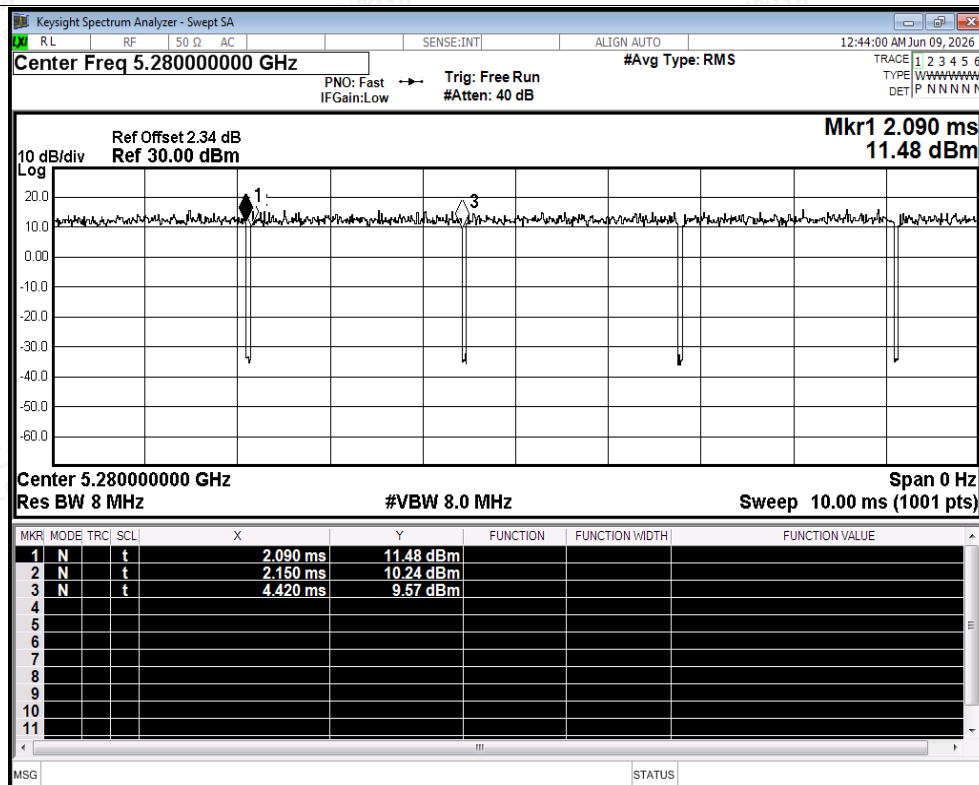

Duty Cycle NVNT ac20 5280MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

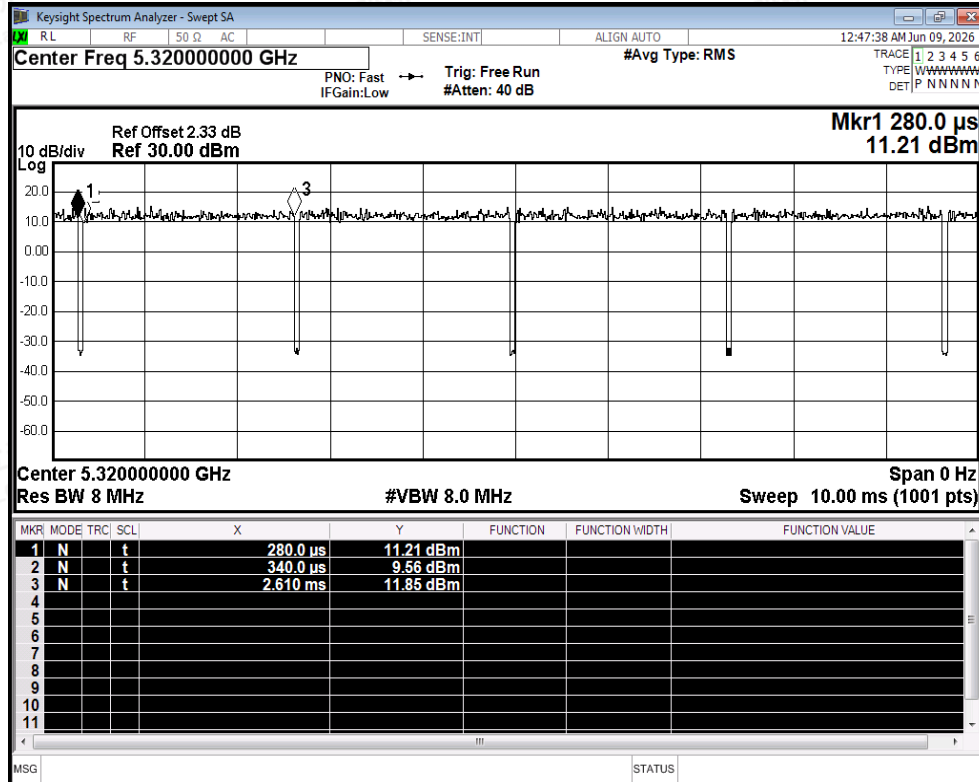

Duty Cycle NVNT ac20 5320MHz Ant2

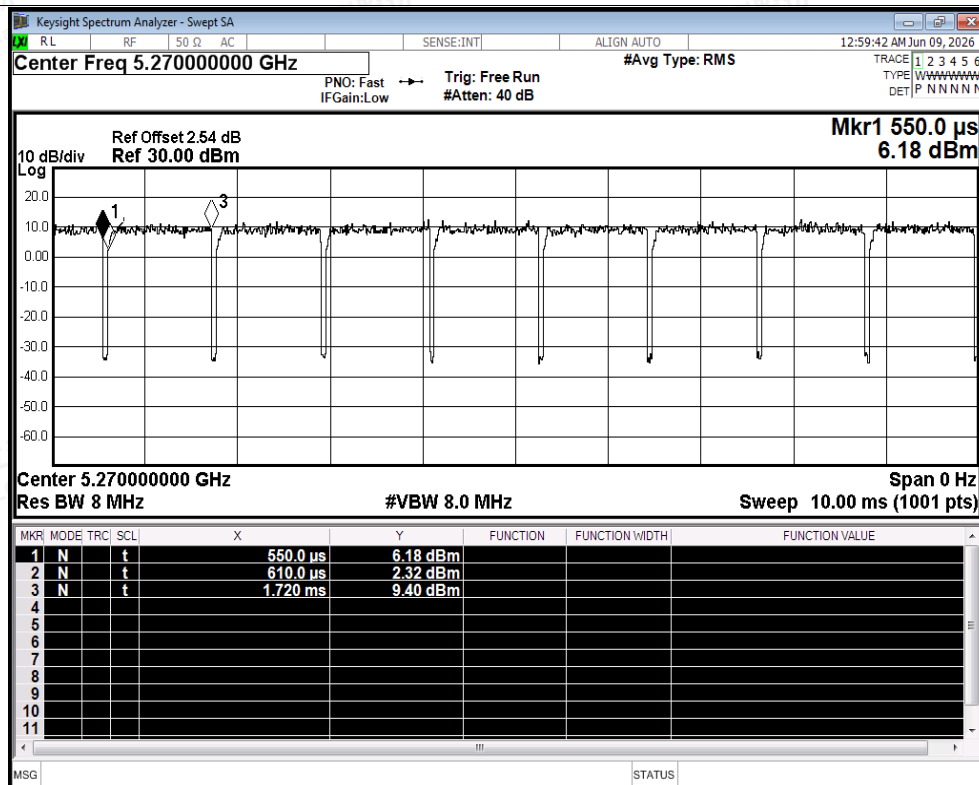

Duty Cycle NVNT ac40 5270MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

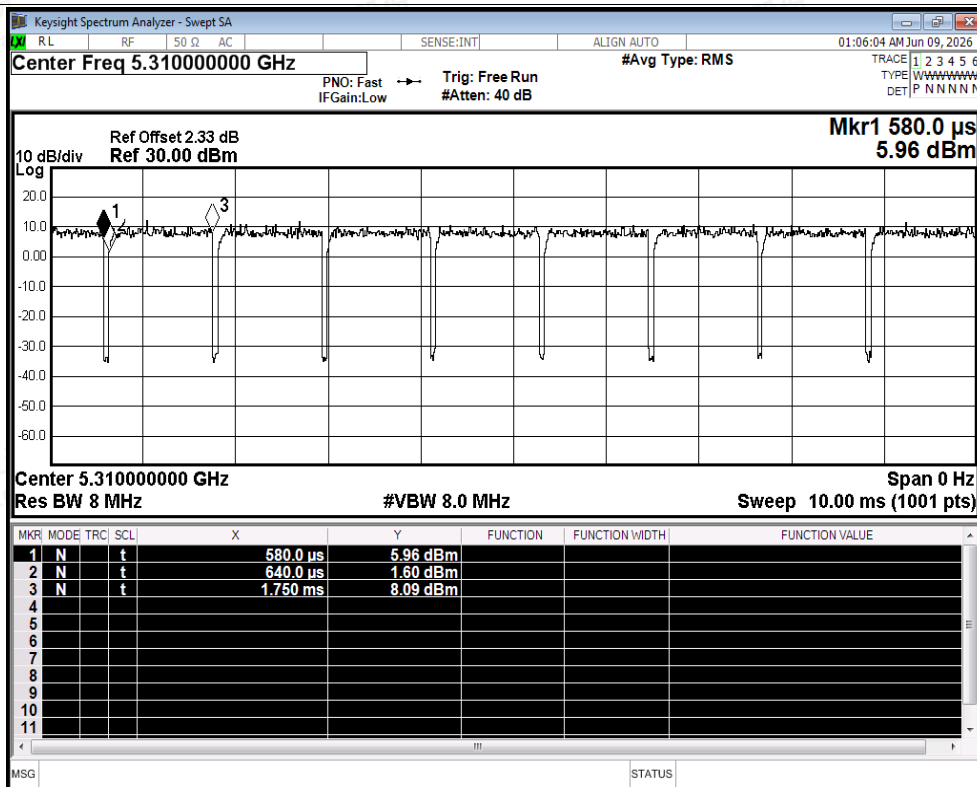

Duty Cycle NVNT ac40 5310MHz Ant2

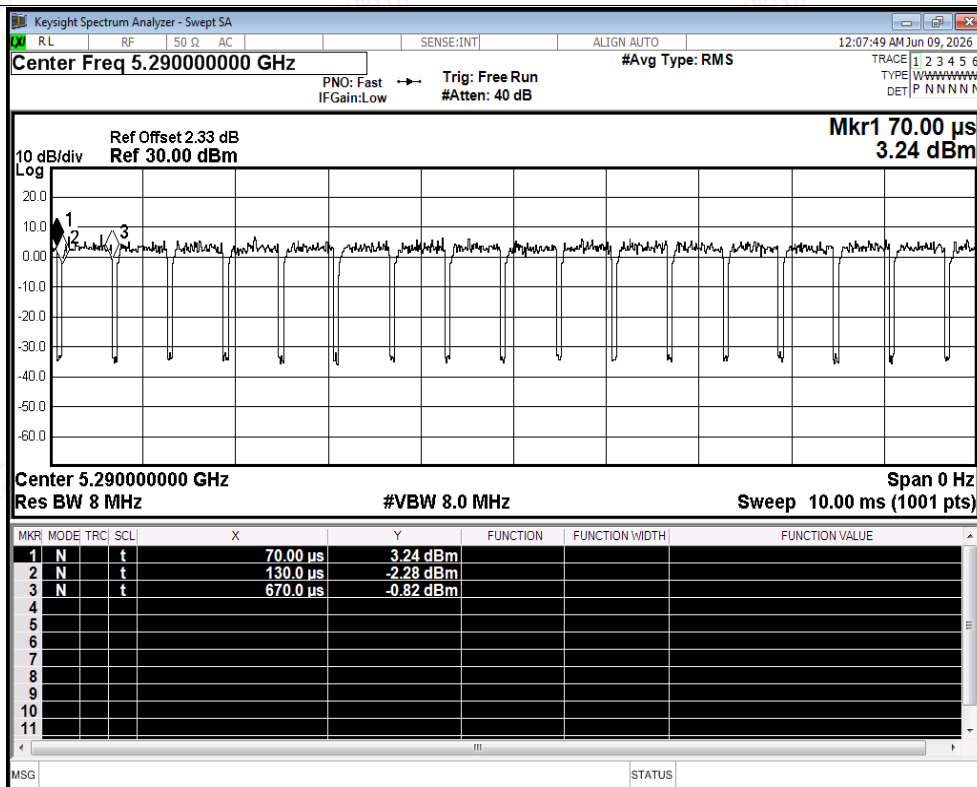

Duty Cycle NVNT ac80 5290MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

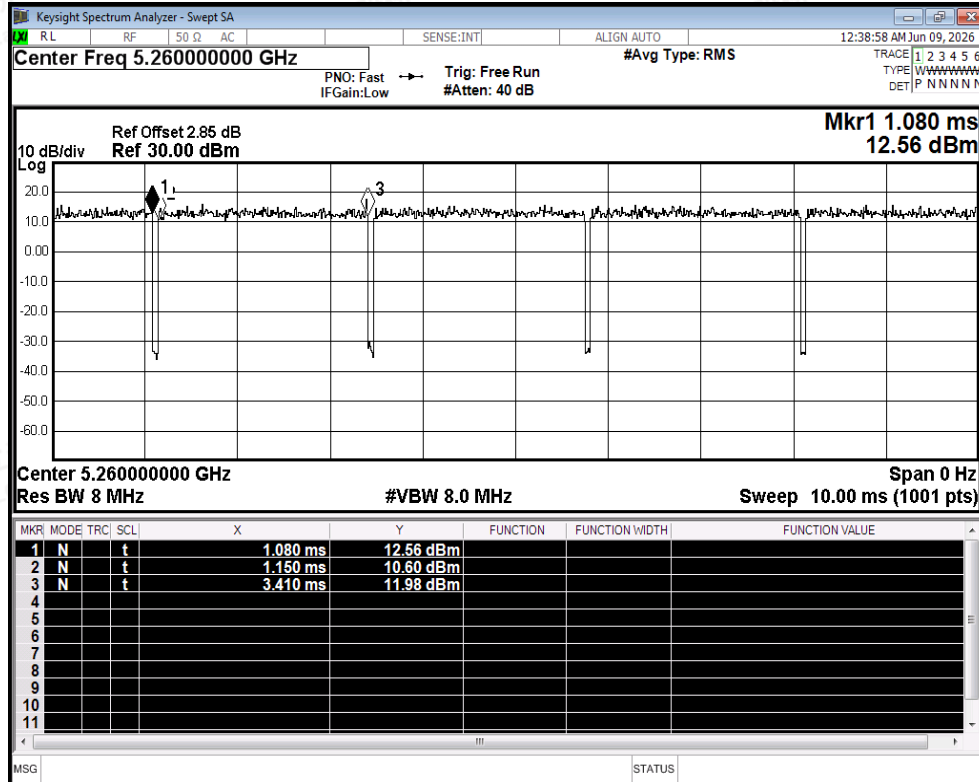

Duty Cycle NVNT ax20 5260MHz Ant2

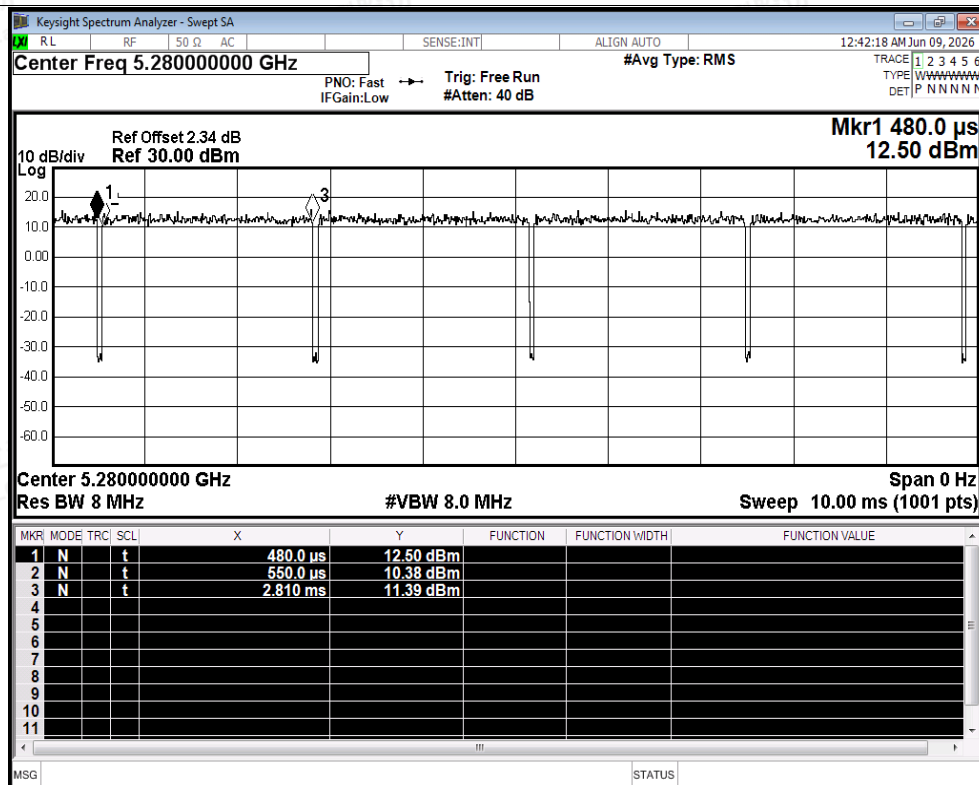

Duty Cycle NVNT ax20 5280MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

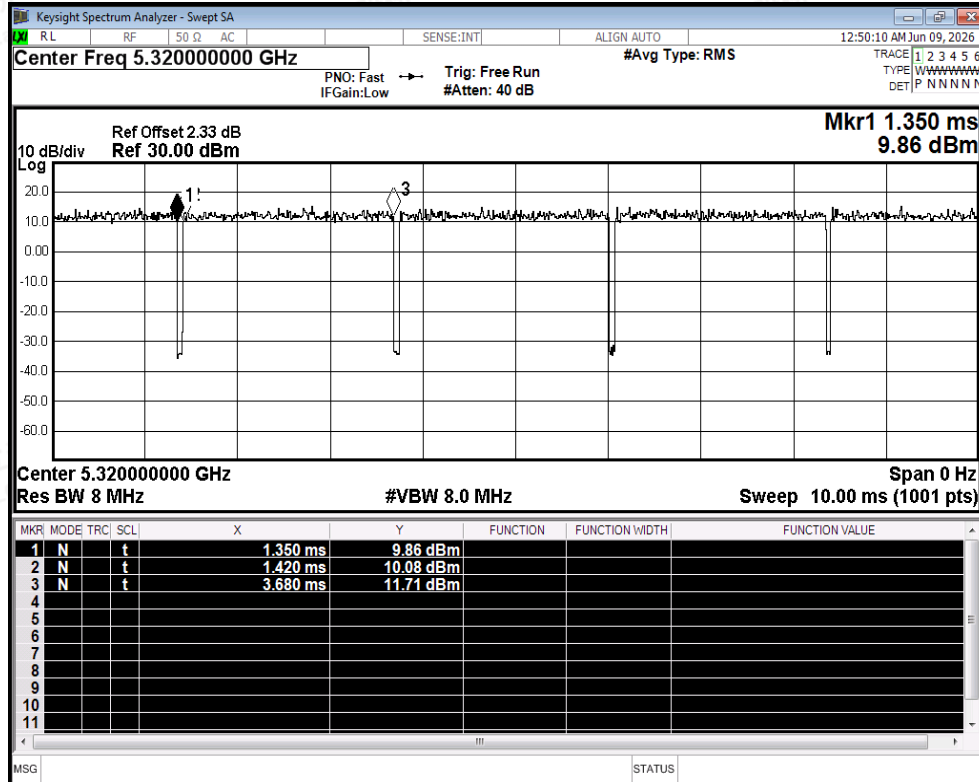

Duty Cycle NVNT ax20 5320MHz Ant2

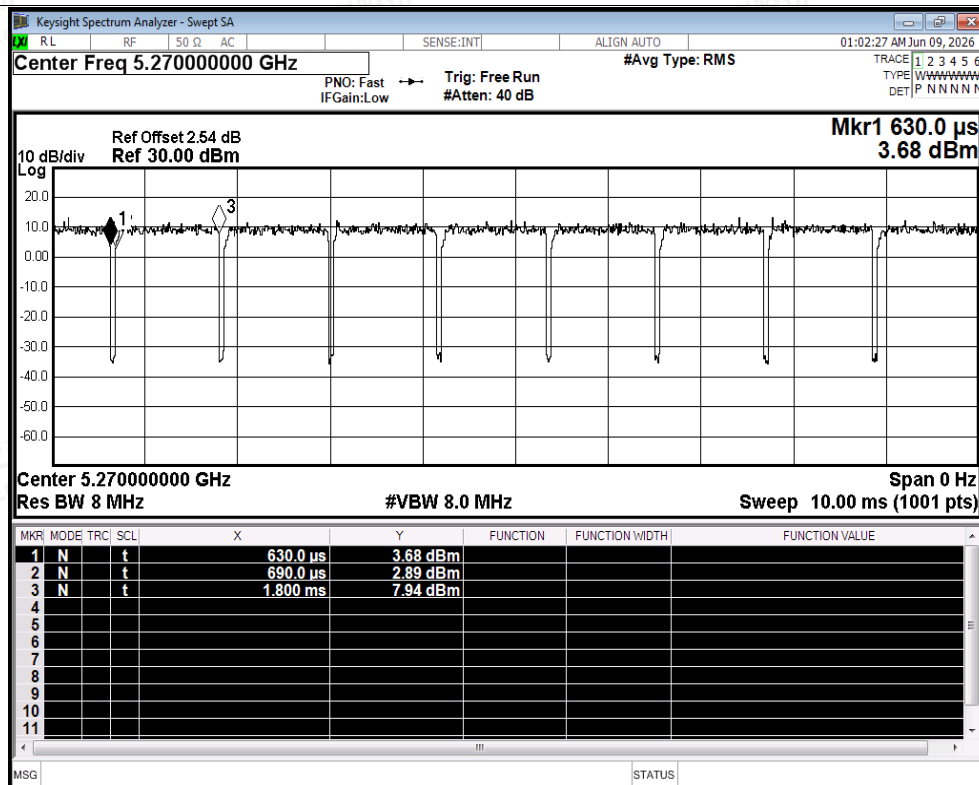

Duty Cycle NVNT ax40 5270MHz Ant2




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

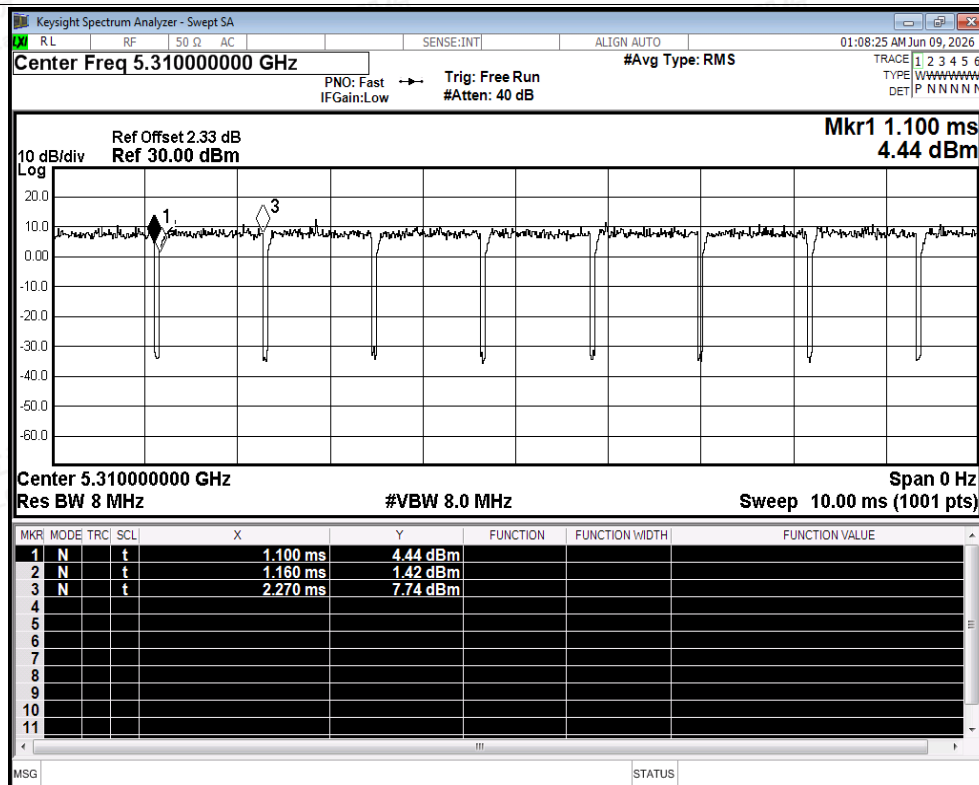

Duty Cycle NVNT ax40 5310MHz Ant2

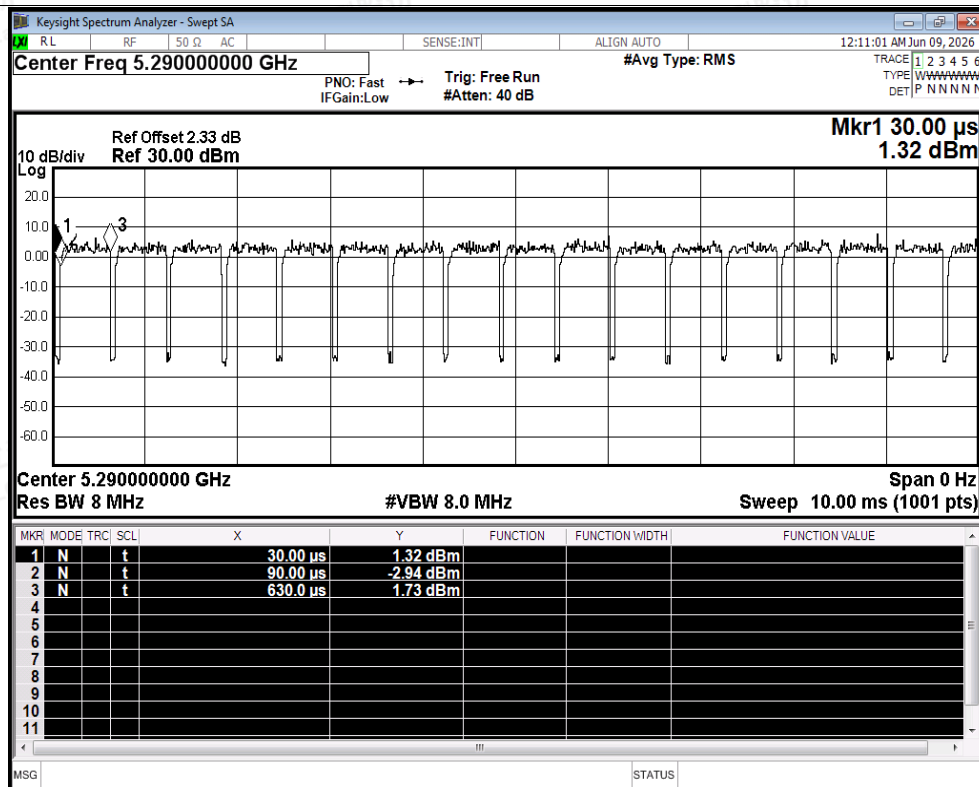

Duty Cycle NVNT ax80 5290MHz Ant2



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity