



F.4 Restrict Band

Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5500	Ant1	5460	-50.26	5.68	50.68	Peak	68.2	Pass
NVNT	a	5500	Ant1	5460	-56.71	5.68	44.23	Average	54	Pass
NVNT	a	5500	Ant1	5470	-44.03	5.68	56.91	Peak	68.2	Pass
NVNT	a	5500	Ant1	5469.8	-55.73	5.68	45.21	Average	54	Pass
NVNT	a	5500	Ant1	5470	-44.03	5.68	56.91	Peak	68.2	Pass
NVNT	a	5500	Ant1	5470	-55.85	5.68	45.09	Average	54	Pass
NVNT	a	5700	Ant1	5725	-44.37	5.68	56.57	Peak	68.2	Pass
NVNT	a	5700	Ant1	5725	-54.58	5.68	46.36	Average	54	Pass
NVNT	a	5700	Ant1	5727.2	-44.35	5.68	56.59	Peak	68.2	Pass
NVNT	a	5700	Ant1	5725.2	-54.54	5.68	46.40	Average	54	Pass
NVNT	a	5700	Ant1	5735	-48.72	5.68	52.22	Peak	68.2	Pass
NVNT	a	5700	Ant1	5735	-56.76	5.68	44.18	Average	54	Pass
NVNT	n20	5500	Ant1	5460	-48.64	5.68	52.30	Peak	68.2	Pass
NVNT	n20	5500	Ant1	5460	-56.55	5.68	44.39	Average	54	Pass
NVNT	n20	5500	Ant1	5470	-45.54	5.68	55.40	Peak	68.2	Pass
NVNT	n20	5500	Ant1	5469.8	-54.86	5.68	46.08	Average	54	Pass
NVNT	n20	5500	Ant1	5470	-45.54	5.68	55.40	Peak	68.2	Pass
NVNT	n20	5500	Ant1	5470	-55.17	5.68	45.77	Average	54	Pass
NVNT	n20	5700	Ant1	5725	-39.68	5.68	61.26	Peak	68.2	Pass
NVNT	n20	5700	Ant1	5725	-53.34	5.68	47.60	Average	54	Pass
NVNT	n20	5700	Ant1	5726.6	-38.85	5.68	62.09	Peak	68.2	Pass
NVNT	n20	5700	Ant1	5725	-53.34	5.68	47.60	Average	54	Pass
NVNT	n20	5700	Ant1	5735	-50.03	5.68	50.91	Peak	68.2	Pass
NVNT	n20	5700	Ant1	5735	-56.51	5.68	44.43	Average	54	Pass
NVNT	n40	5510	Ant1	5460	-57.4	5.68	43.54	Peak	68.2	Pass
NVNT	n40	5510	Ant1	5460	-64.4	5.68	36.54	Average	54	Pass
NVNT	n40	5510	Ant1	5470	-46.01	5.68	54.93	Peak	68.2	Pass
NVNT	n40	5510	Ant1	5470	-58.8	5.68	42.14	Average	54	Pass
NVNT	n40	5510	Ant1	5470	-46.01	5.68	54.93	Peak	68.2	Pass
NVNT	n40	5510	Ant1	5470	-58.8	5.68	42.14	Average	54	Pass
NVNT	n40	5670	Ant1	5725	-49.67	5.68	51.27	Peak	68.2	Pass
NVNT	n40	5670	Ant1	5725	-56.87	5.68	44.07	Average	54	Pass
NVNT	n40	5670	Ant1	5734.8	-47.95	5.68	52.99	Peak	68.2	Pass
NVNT	n40	5670	Ant1	5733.2	-56.62	5.68	44.32	Average	54	Pass
NVNT	n40	5670	Ant1	5735	-50.2	5.68	50.74	Peak	68.2	Pass
NVNT	n40	5670	Ant1	5735	-56.81	5.68	44.13	Average	54	Pass
NVNT	ac20	5500	Ant1	5460	-49.9	5.68	51.04	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5500	Ant1	5460	-56.75	5.68	44.19	Average	54	Pass
NVNT	ac20	5500	Ant1	5468.4	-40.57	5.68	60.37	Peak	68.2	Pass
NVNT	ac20	5500	Ant1	5470	-55.37	5.68	45.57	Average	54	Pass
NVNT	ac20	5500	Ant1	5470	-49.97	5.68	50.97	Peak	68.2	Pass
NVNT	ac20	5500	Ant1	5470	-55.37	5.68	45.57	Average	54	Pass
NVNT	ac20	5700	Ant1	5725	-41.31	5.68	59.63	Peak	68.2	Pass
NVNT	ac20	5700	Ant1	5725	-53.91	5.68	47.03	Average	54	Pass
NVNT	ac20	5700	Ant1	5725	-41.31	5.68	59.63	Peak	68.2	Pass
NVNT	ac20	5700	Ant1	5725	-53.91	5.68	47.03	Average	54	Pass
NVNT	ac20	5700	Ant1	5735	-49.85	5.68	51.09	Peak	68.2	Pass
NVNT	ac20	5700	Ant1	5735	-56.73	5.68	44.21	Average	54	Pass
NVNT	ac40	5510	Ant1	5460	-57.57	5.68	43.37	Peak	68.2	Pass
NVNT	ac40	5510	Ant1	5460	-64.38	5.68	36.56	Average	54	Pass
NVNT	ac40	5510	Ant1	5469.6	-45.67	5.68	55.27	Peak	68.2	Pass
NVNT	ac40	5510	Ant1	5470	-58.72	5.68	42.22	Average	54	Pass
NVNT	ac40	5510	Ant1	5470	-47.58	5.68	53.36	Peak	68.2	Pass
NVNT	ac40	5510	Ant1	5470	-58.72	5.68	42.22	Average	54	Pass
NVNT	ac40	5670	Ant1	5725	-50.95	5.68	49.99	Peak	68.2	Pass
NVNT	ac40	5670	Ant1	5725	-56.68	5.68	44.26	Average	54	Pass
NVNT	ac40	5670	Ant1	5735	-47.67	5.68	53.27	Peak	68.2	Pass
NVNT	ac40	5670	Ant1	5725.2	-56.64	5.68	44.30	Average	54	Pass
NVNT	ac40	5670	Ant1	5735	-47.67	5.68	53.27	Peak	68.2	Pass
NVNT	ac40	5670	Ant1	5735	-56.82	5.68	44.12	Average	54	Pass
NVNT	ac80	5530	Ant1	5460	-49.29	5.68	51.65	Peak	68.2	Pass
NVNT	ac80	5530	Ant1	5460	-55.62	5.68	45.32	Average	54	Pass
NVNT	ac80	5530	Ant1	5467.2	-45.35	5.68	55.59	Peak	68.2	Pass
NVNT	ac80	5530	Ant1	5469.8	-54.77	5.68	46.17	Average	54	Pass
NVNT	ac80	5530	Ant1	5470	-48.86	5.68	52.08	Peak	68.2	Pass
NVNT	ac80	5530	Ant1	5470	-54.86	5.68	46.08	Average	54	Pass
NVNT	ac80	5610	Ant1	5725	-49.44	5.68	51.50	Peak	68.2	Pass
NVNT	ac80	5610	Ant1	5725	-56.57	5.68	44.37	Average	54	Pass
NVNT	ac80	5610	Ant1	5735	-48.27	5.68	52.67	Peak	68.2	Pass
NVNT	ac80	5610	Ant1	5734.795	-55.98	5.68	44.96	Average	54	Pass
NVNT	ac80	5610	Ant1	5735	-48.27	5.68	52.67	Peak	68.2	Pass
NVNT	ac80	5610	Ant1	5735	-56.01	5.68	44.93	Average	54	Pass
NVNT	ax20	5500	Ant1	5460	-49.41	5.68	51.53	Peak	68.2	Pass
NVNT	ax20	5500	Ant1	5460	-56.65	5.68	44.29	Average	54	Pass
NVNT	ax20	5500	Ant1	5469.6	-44.5	5.68	56.44	Peak	68.2	Pass
NVNT	ax20	5500	Ant1	5469.8	-55.46	5.68	45.48	Average	54	Pass
NVNT	ax20	5500	Ant1	5470	-45.31	5.68	55.63	Peak	68.2	Pass
NVNT	ax20	5500	Ant1	5470	-55.46	5.68	45.48	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax20	5700	Ant1	5725	-42.8	5.68	58.14	Peak	68.2	Pass
NVNT	ax20	5700	Ant1	5725	-54	5.68	46.94	Average	54	Pass
NVNT	ax20	5700	Ant1	5726.4	-40.84	5.68	60.10	Peak	68.2	Pass
NVNT	ax20	5700	Ant1	5725.2	-53.89	5.68	47.05	Average	54	Pass
NVNT	ax20	5700	Ant1	5735	-49.96	5.68	50.98	Peak	68.2	Pass
NVNT	ax20	5700	Ant1	5735	-56.75	5.68	44.19	Average	54	Pass
NVNT	ax40	5510	Ant1	5460	-49.09	5.68	51.85	Peak	68.2	Pass
NVNT	ax40	5510	Ant1	5460	-56.63	5.68	44.31	Average	54	Pass
NVNT	ax40	5510	Ant1	5469	-44.1	5.68	56.84	Peak	68.2	Pass
NVNT	ax40	5510	Ant1	5468.8	-55.19	5.68	45.75	Average	54	Pass
NVNT	ax40	5510	Ant1	5470	-48.24	5.68	52.70	Peak	68.2	Pass
NVNT	ax40	5510	Ant1	5470	-55.24	5.68	45.70	Average	54	Pass
NVNT	ax40	5670	Ant1	5725	-50.42	5.68	50.52	Peak	68.2	Pass
NVNT	ax40	5670	Ant1	5725	-56.8	5.68	44.14	Average	54	Pass
NVNT	ax40	5670	Ant1	5729.8	-47.2	5.68	53.74	Peak	68.2	Pass
NVNT	ax40	5670	Ant1	5731.8	-56.47	5.68	44.47	Average	54	Pass
NVNT	ax40	5670	Ant1	5735	-49.94	5.68	51.00	Peak	68.2	Pass
NVNT	ax40	5670	Ant1	5735	-56.83	5.68	44.11	Average	54	Pass
NVNT	ax80	5530	Ant1	5460	-48.49	5.68	52.45	Peak	68.2	Pass
NVNT	ax80	5530	Ant1	5460	-55.82	5.68	45.12	Average	54	Pass
NVNT	ax80	5530	Ant1	5468.4	-46.15	5.68	54.79	Peak	68.2	Pass
NVNT	ax80	5530	Ant1	5469.6	-54.89	5.68	46.05	Average	54	Pass
NVNT	ax80	5530	Ant1	5470	-47.86	5.68	53.08	Peak	68.2	Pass
NVNT	ax80	5530	Ant1	5470	-54.91	5.68	46.03	Average	54	Pass
NVNT	ax80	5610	Ant1	5725	-49.8	5.68	51.14	Peak	68.2	Pass
NVNT	ax80	5610	Ant1	5725	-56.14	5.68	44.80	Average	54	Pass
NVNT	ax80	5610	Ant1	5735	-48.11	5.68	52.83	Peak	68.2	Pass
NVNT	ax80	5610	Ant1	5735	-56.02	5.68	44.92	Average	54	Pass
NVNT	ax80	5610	Ant1	5735	-48.11	5.68	52.83	Peak	68.2	Pass
NVNT	ax80	5610	Ant1	5735	-56.02	5.68	44.92	Average	54	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

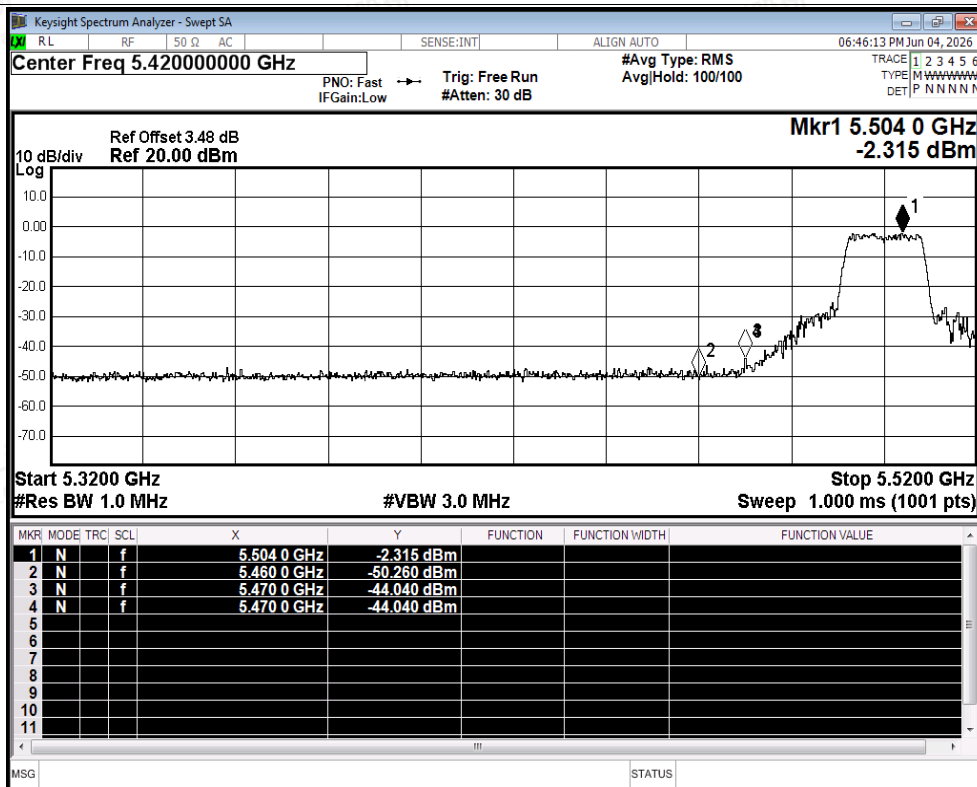

Restrict Band NVNT a 5500MHz Ant1 Peak

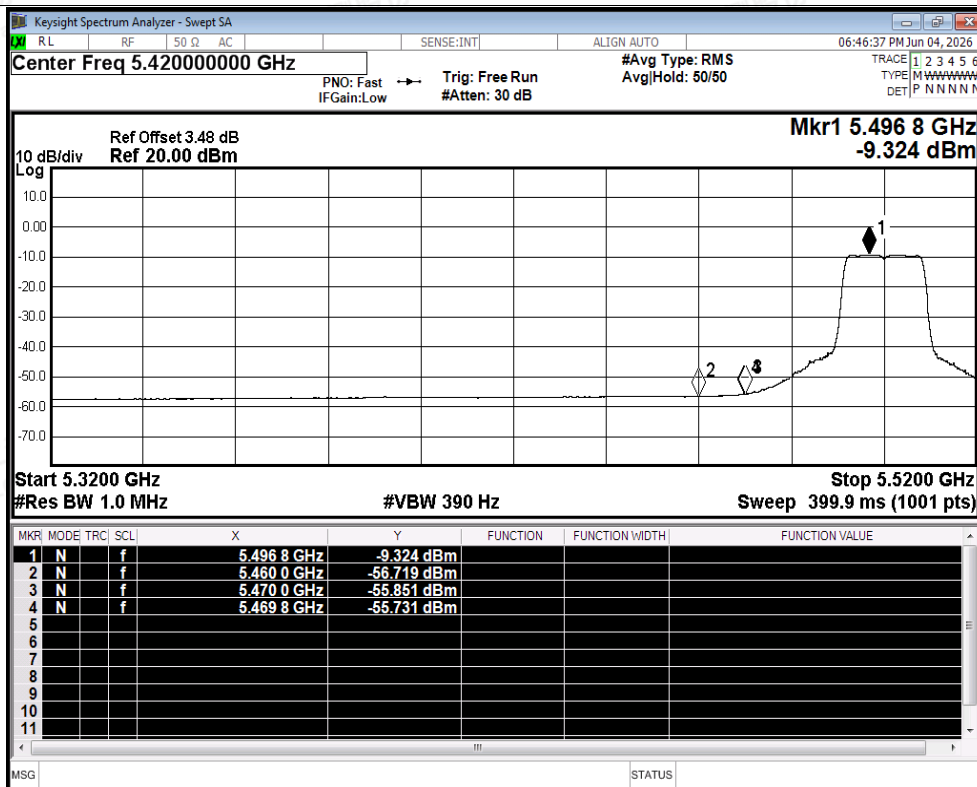

Restrict Band NVNT a 5500MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

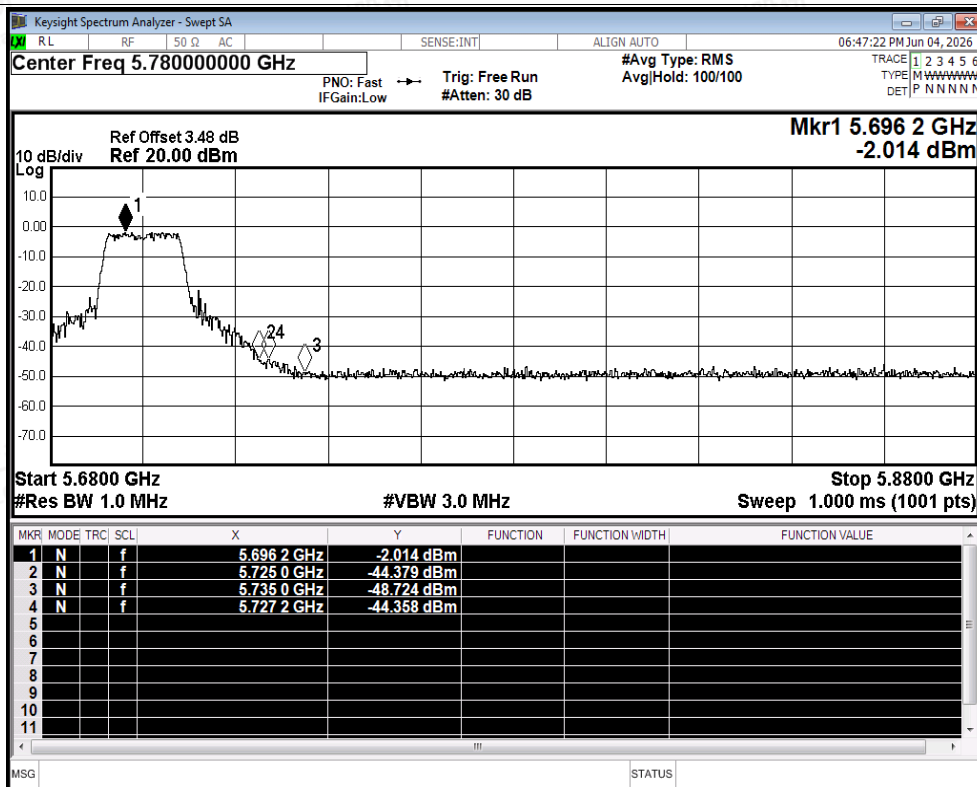

Restrict Band NVNT a 5700MHz Ant1 Peak

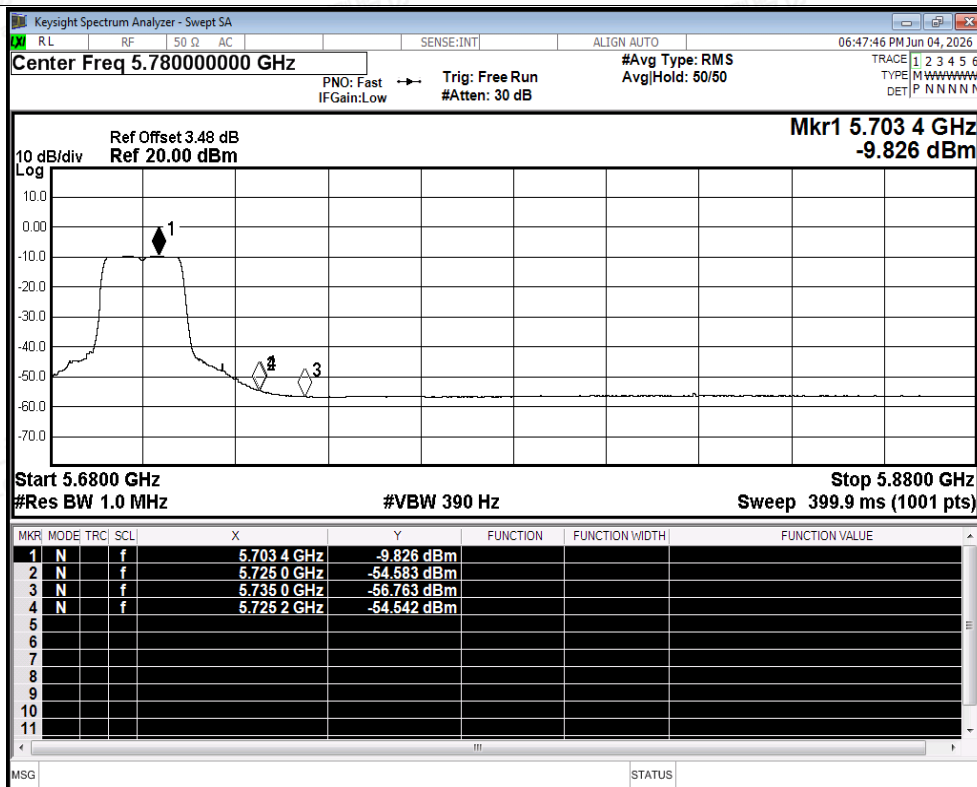

Restrict Band NVNT a 5700MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

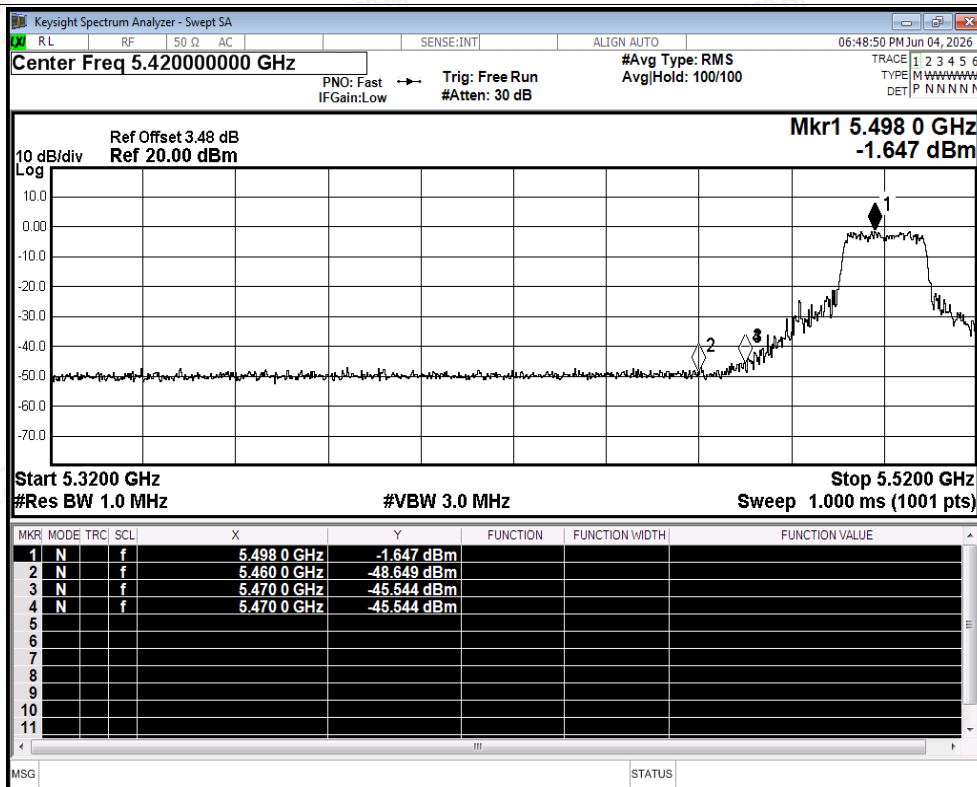

Restrict Band NVNT n20 5500MHz Ant1 Peak

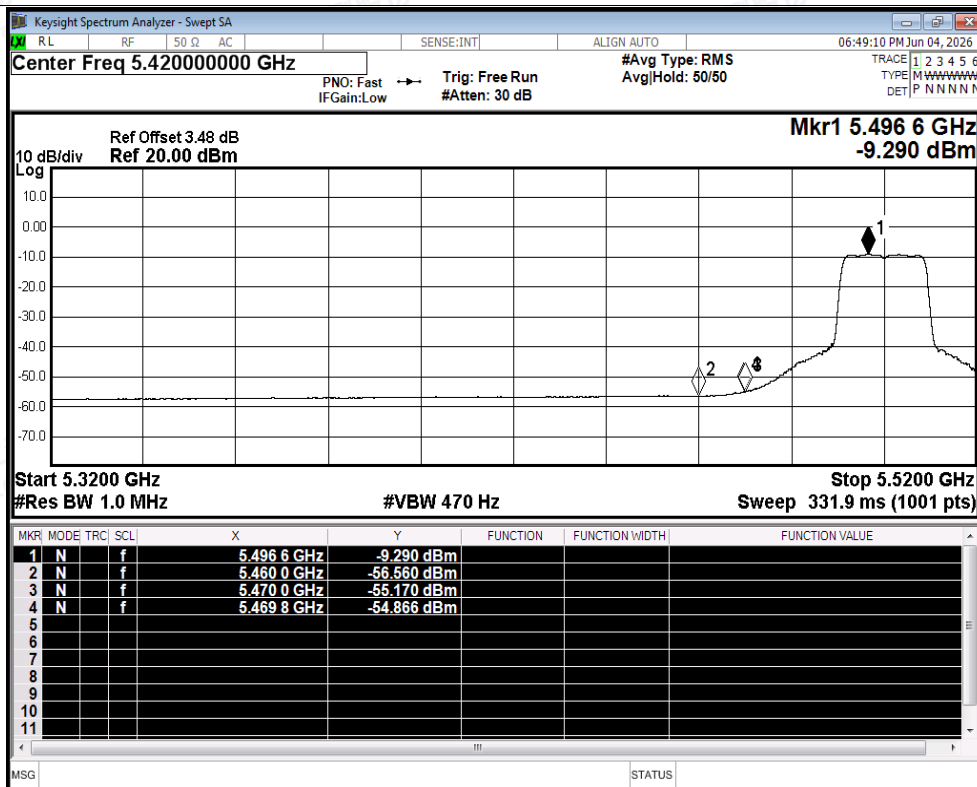

Restrict Band NVNT n20 5500MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

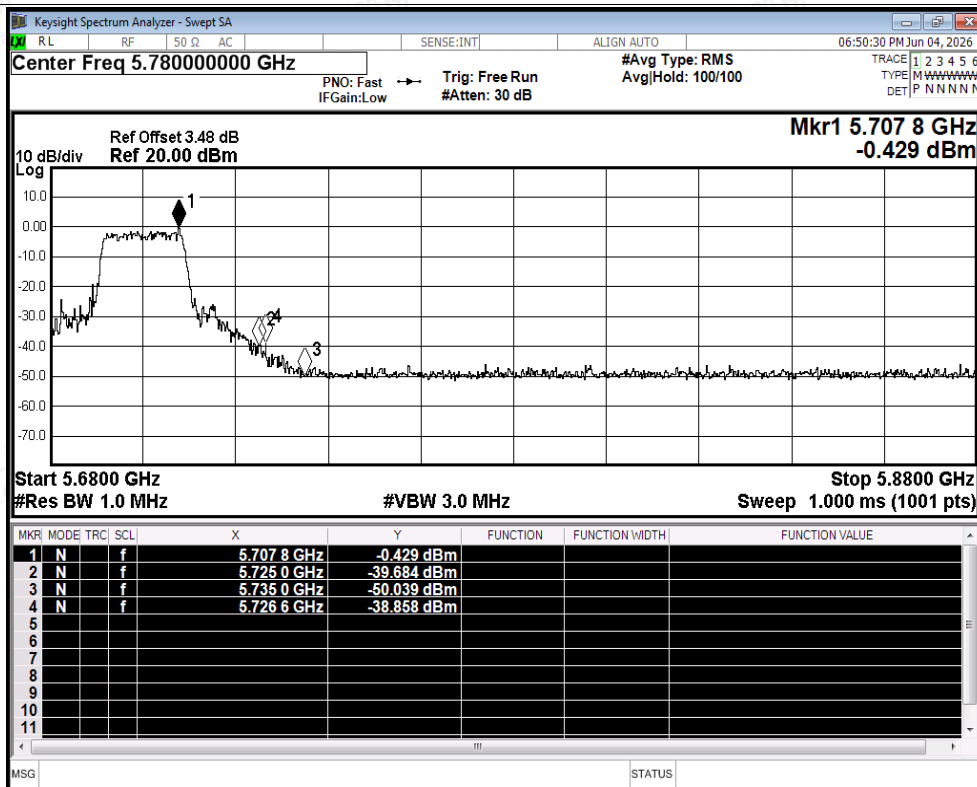

Restrict Band NVNT n20 5700MHz Ant1 Peak

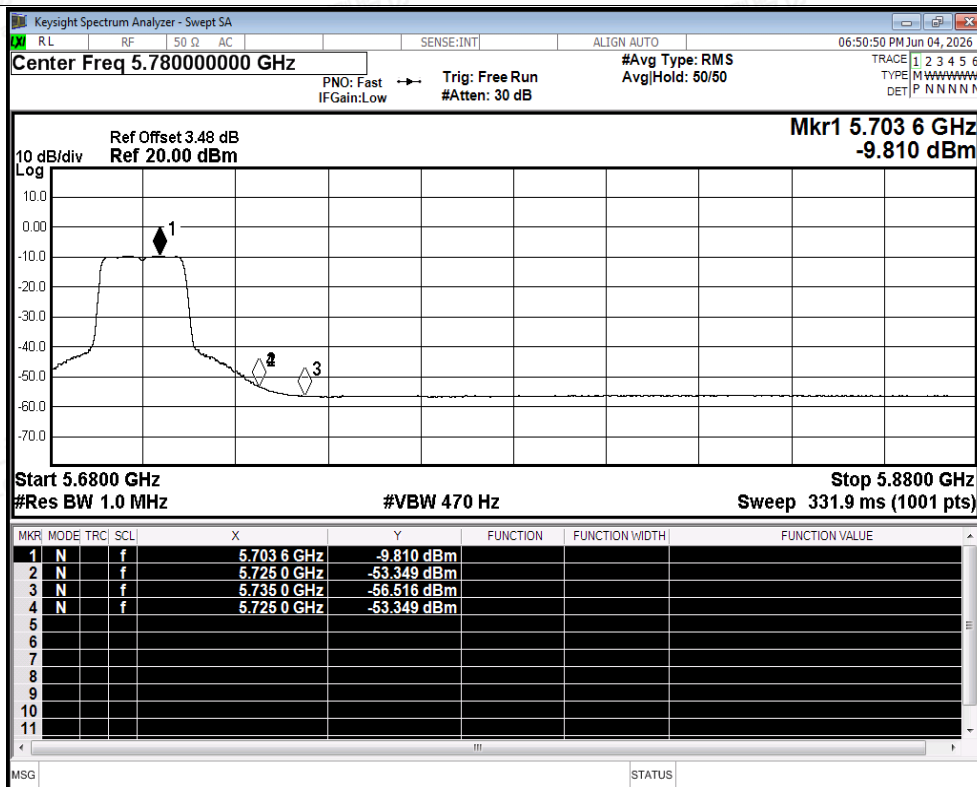

Restrict Band NVNT n20 5700MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

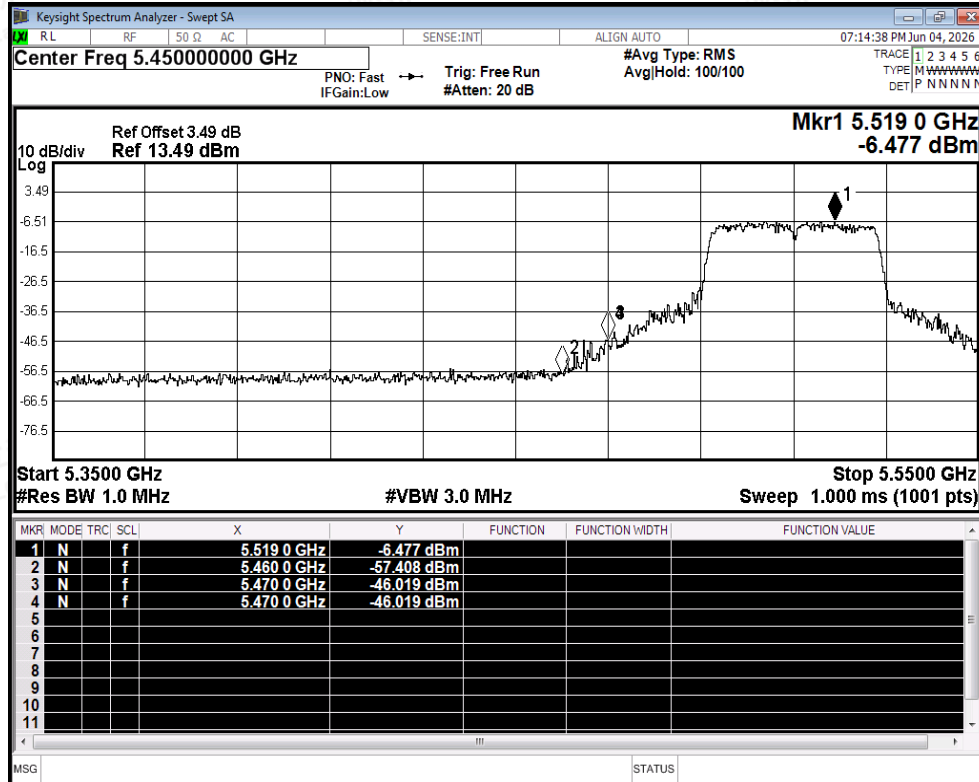

Restrict Band NVNT n40 5510MHz Ant1 Peak

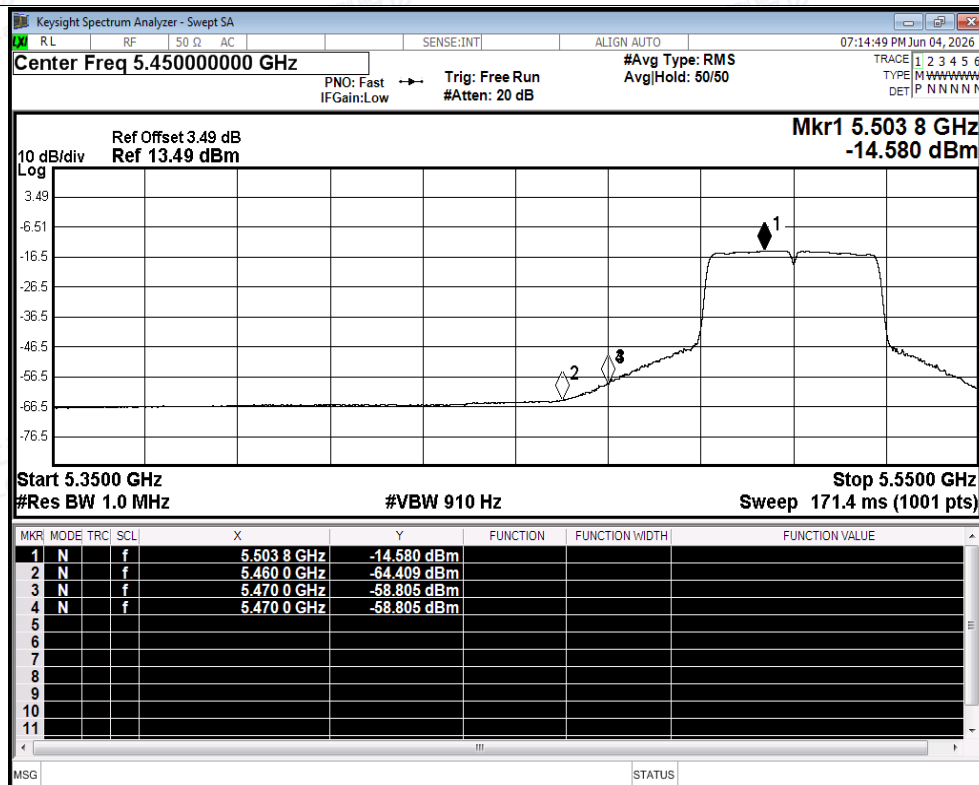

Restrict Band NVNT n40 5510MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

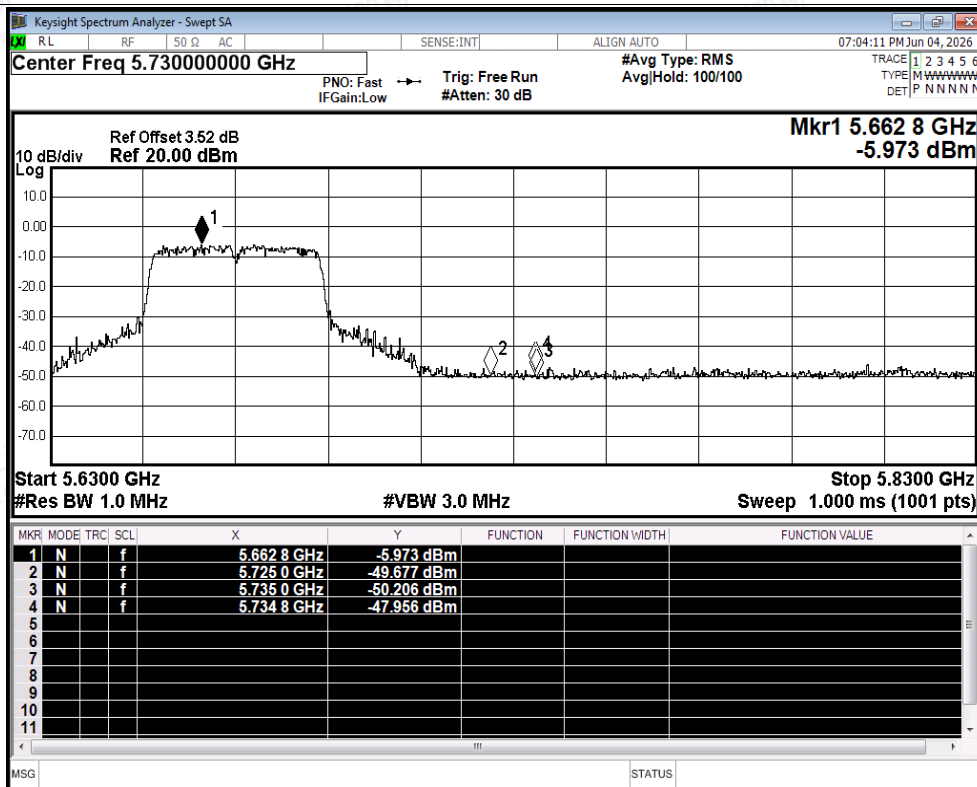

Restrict Band NVNT n40 5670MHz Ant1 Peak

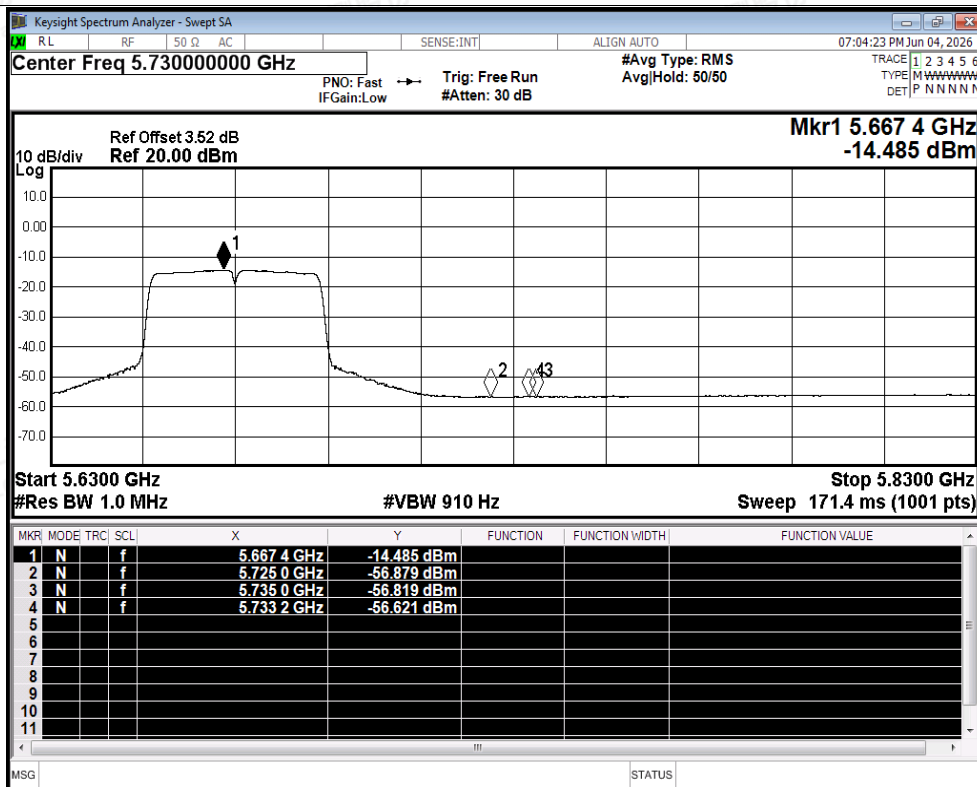

Restrict Band NVNT n40 5670MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

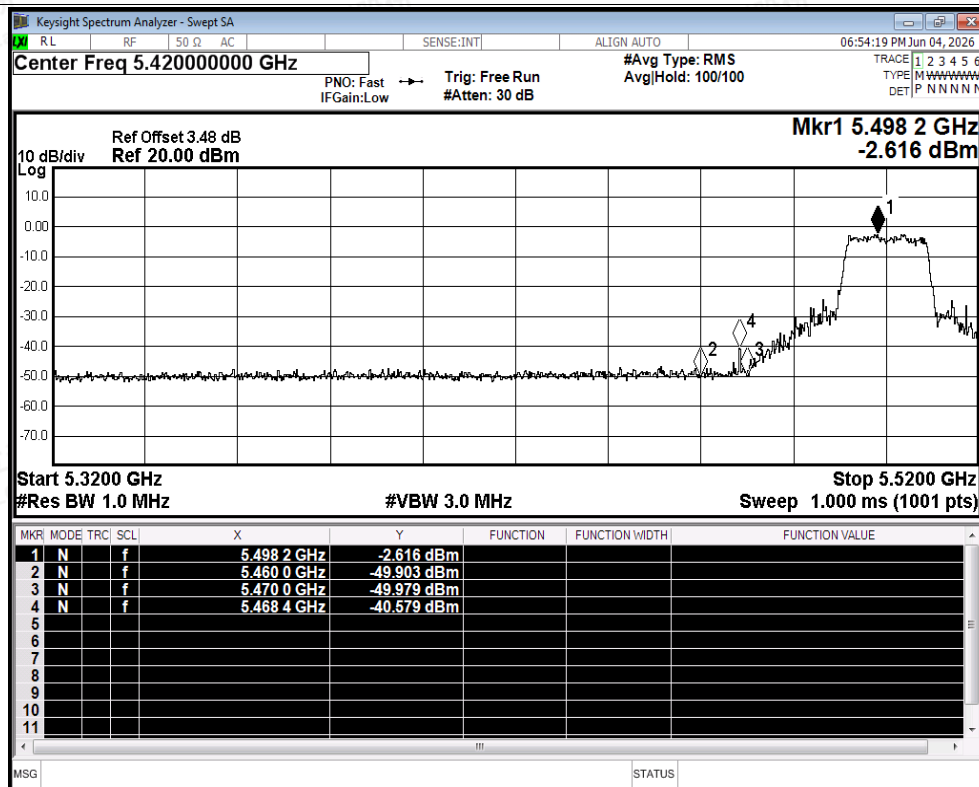

Restrict Band NVNT ac20 5500MHz Ant1 Peak

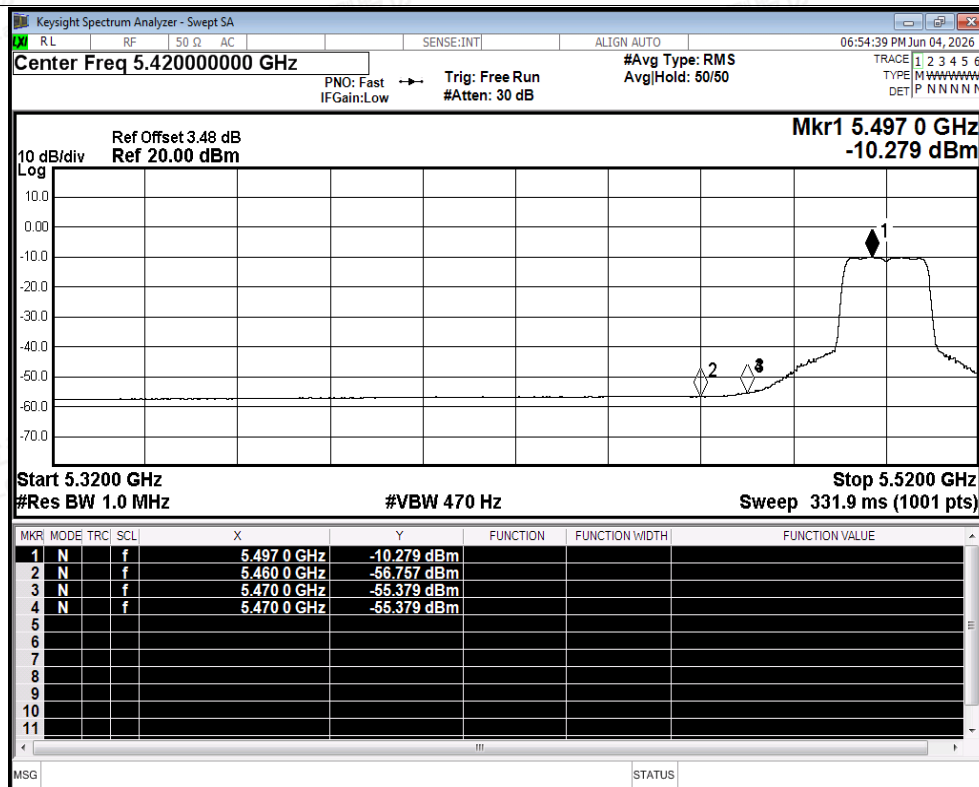

Restrict Band NVNT ac20 5500MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

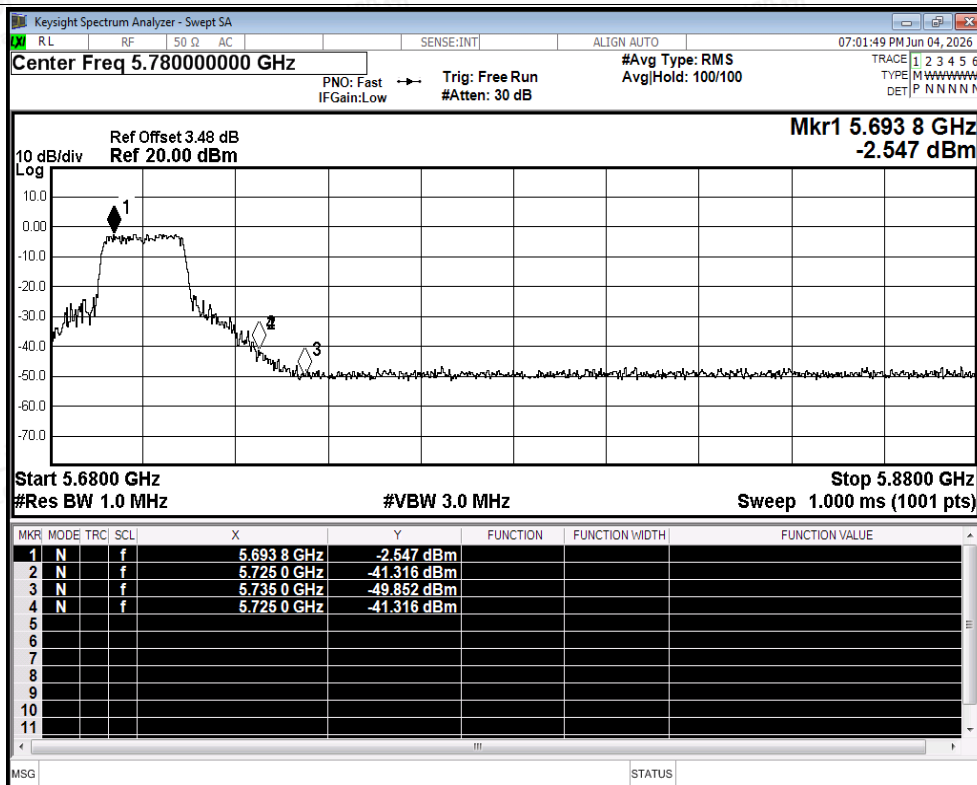

Restrict Band NVNT ac20 5700MHz Ant1 Peak

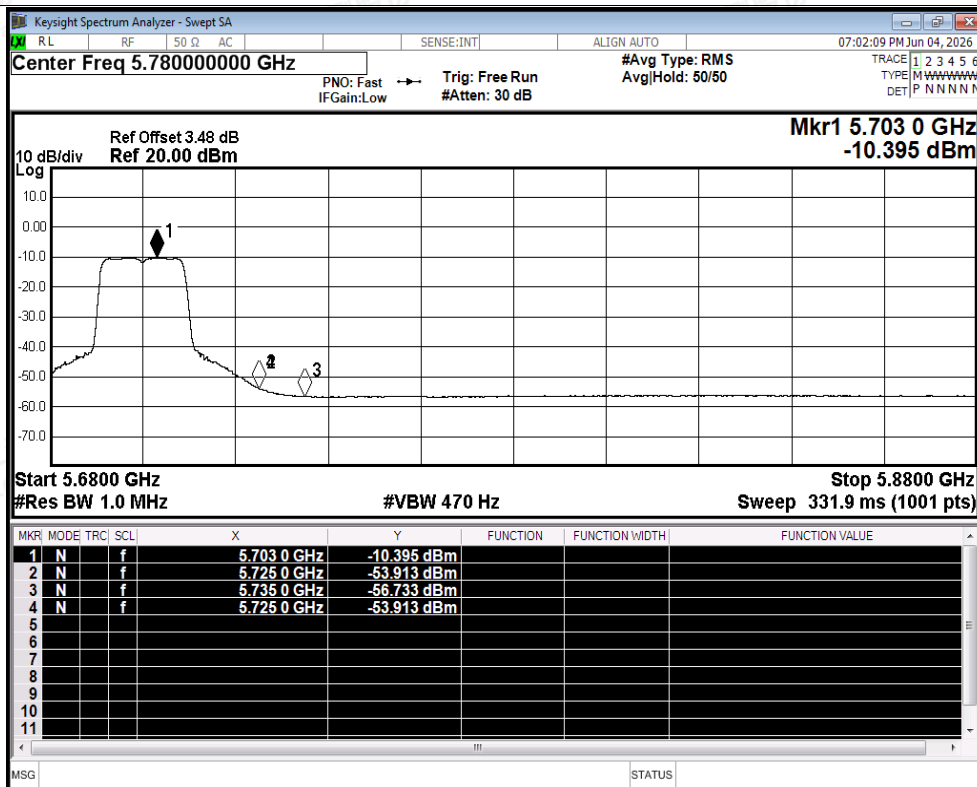

Restrict Band NVNT ac20 5700MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

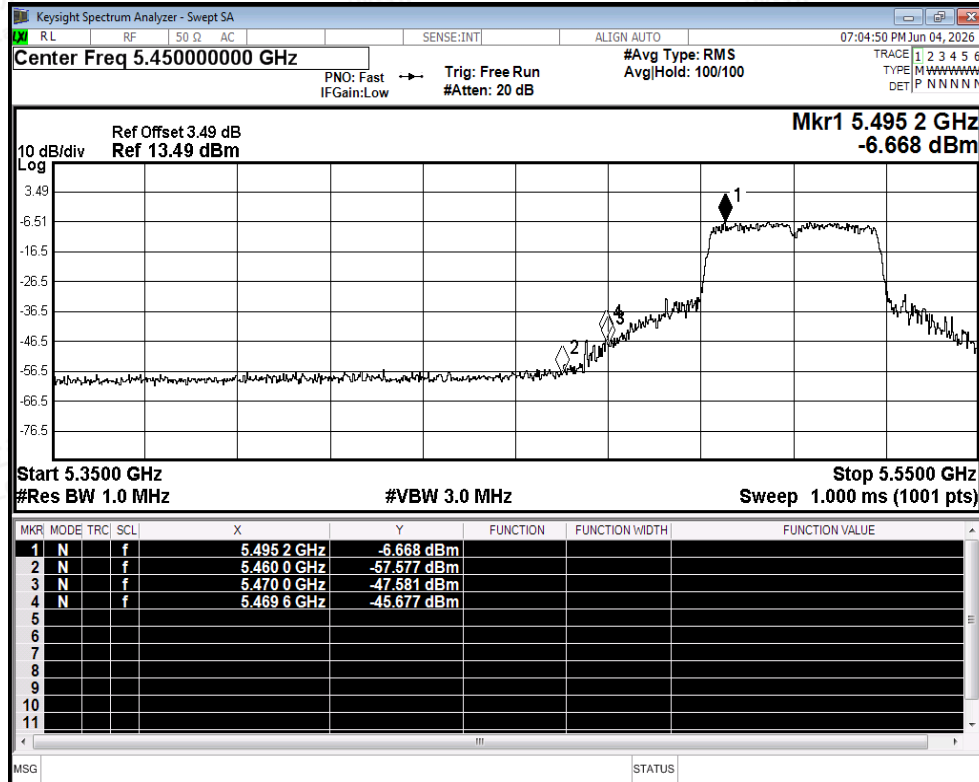

Restrict Band NVNT ac40 5510MHz Ant1 Peak

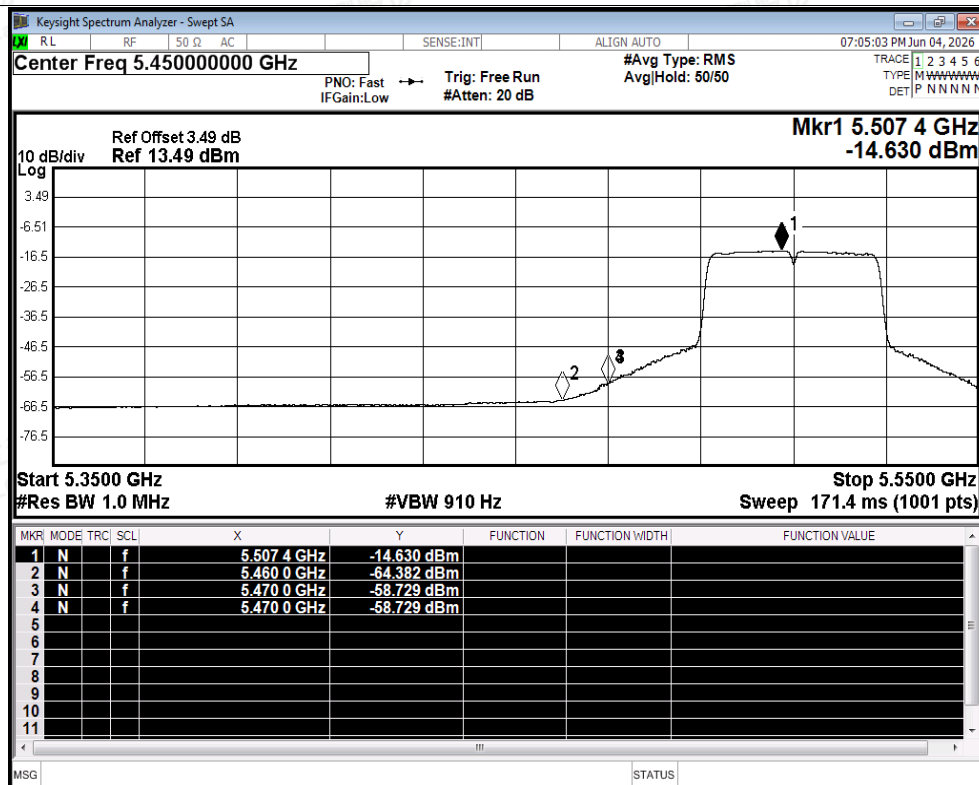

Restrict Band NVNT ac40 5510MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

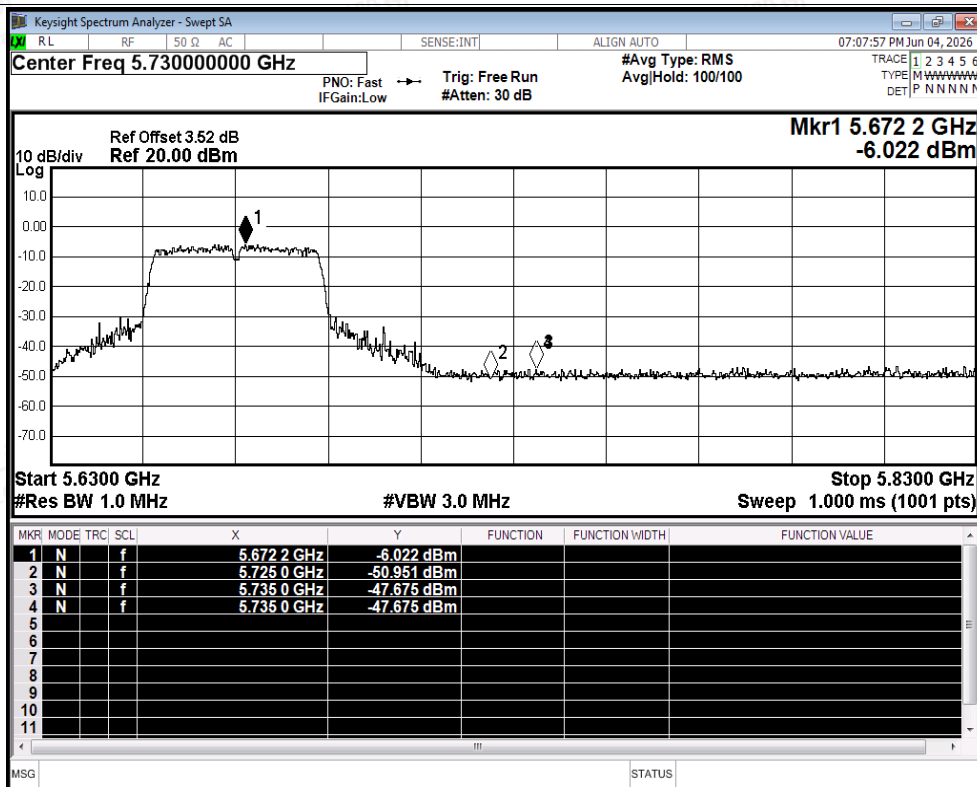

Restrict Band NVNT ac40 5670MHz Ant1 Peak

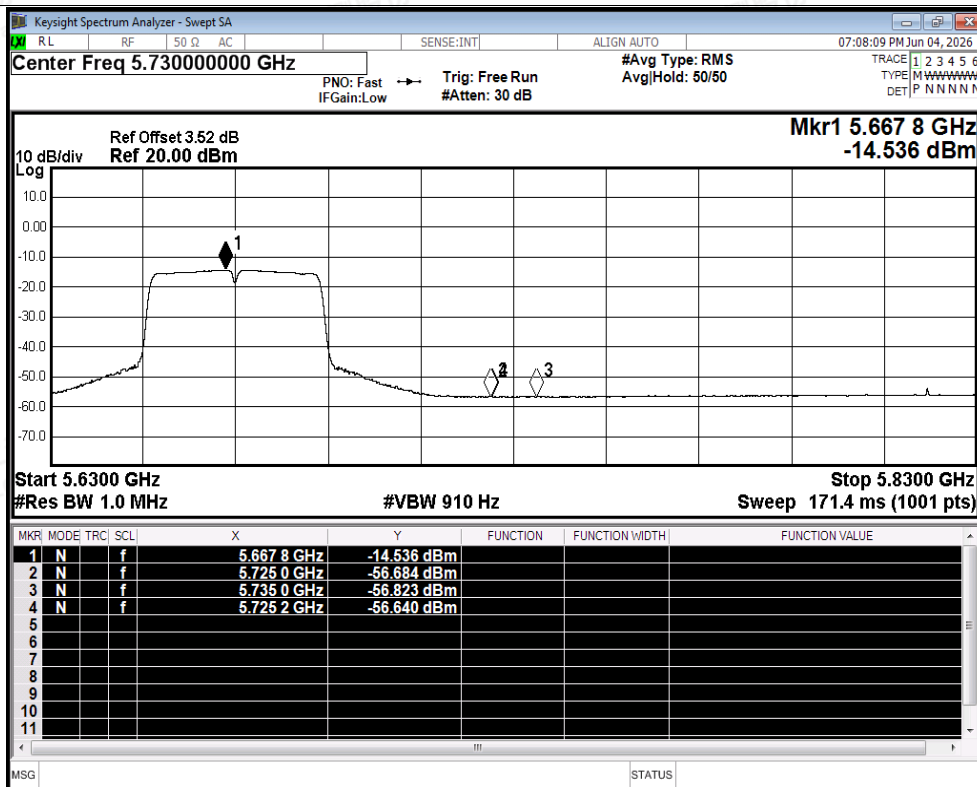

Restrict Band NVNT ac40 5670MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

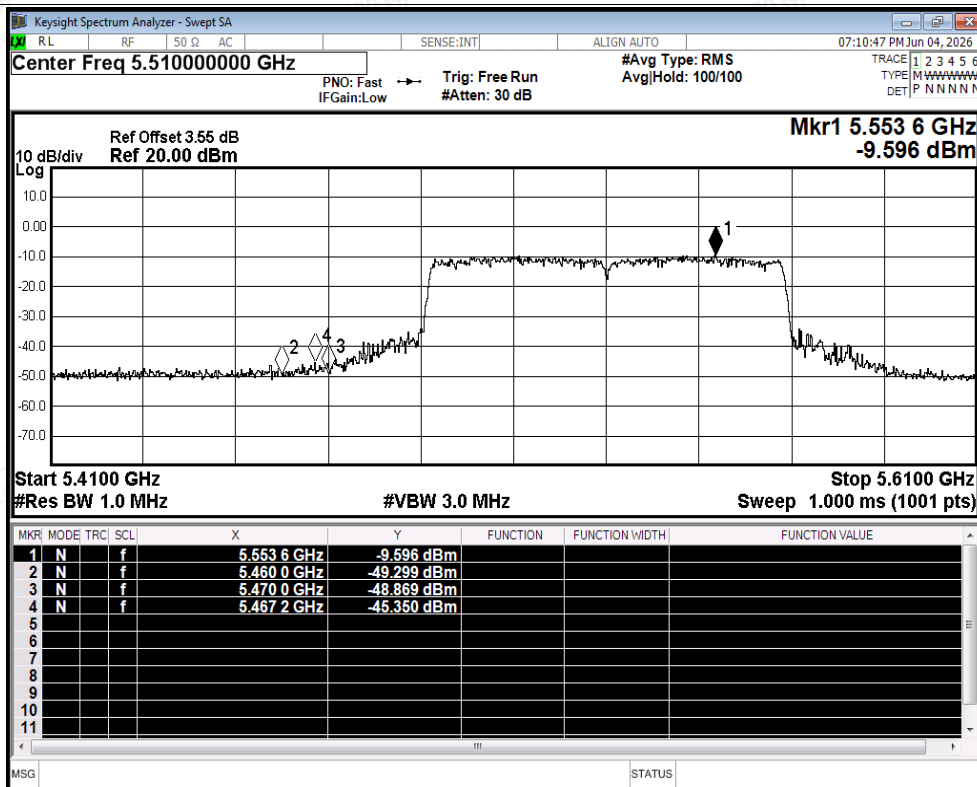

Restrict Band NVNT ac80 5530MHz Ant1 Peak

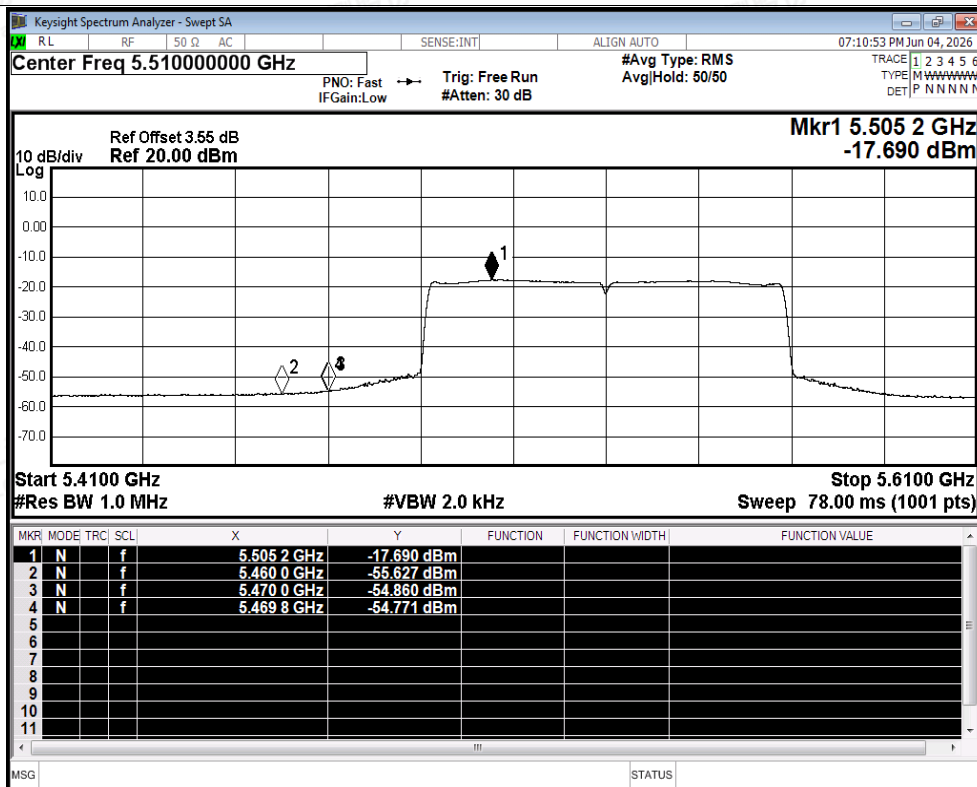

Restrict Band NVNT ac80 5530MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

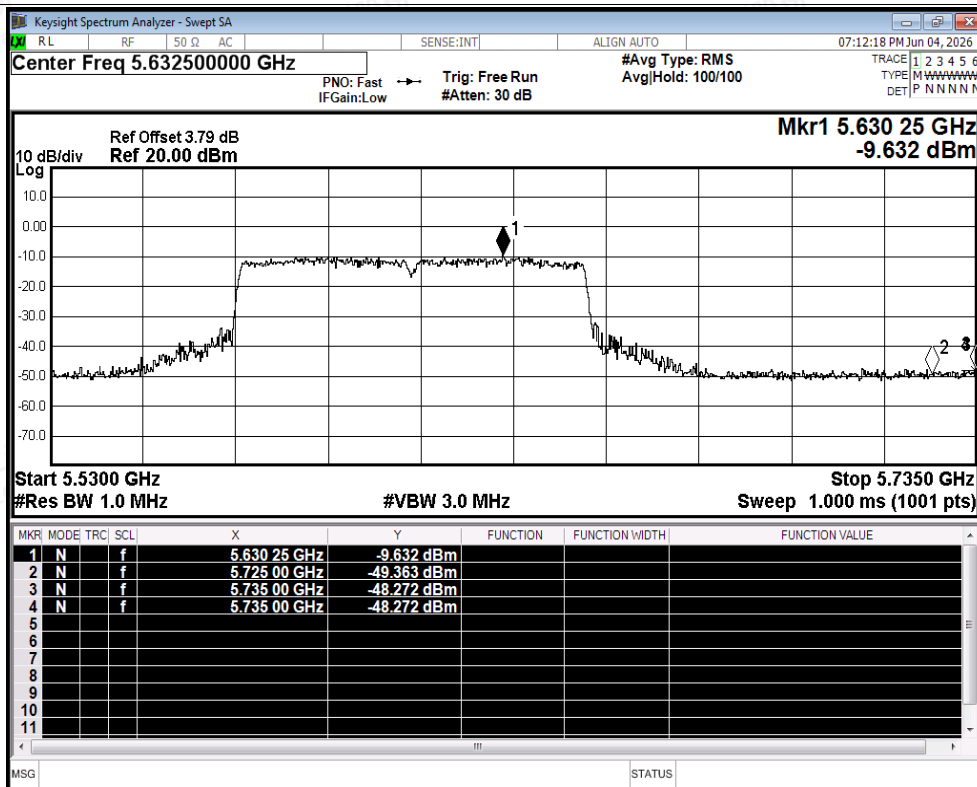

Restrict Band NVNT ac80 5610MHz Ant1 Peak

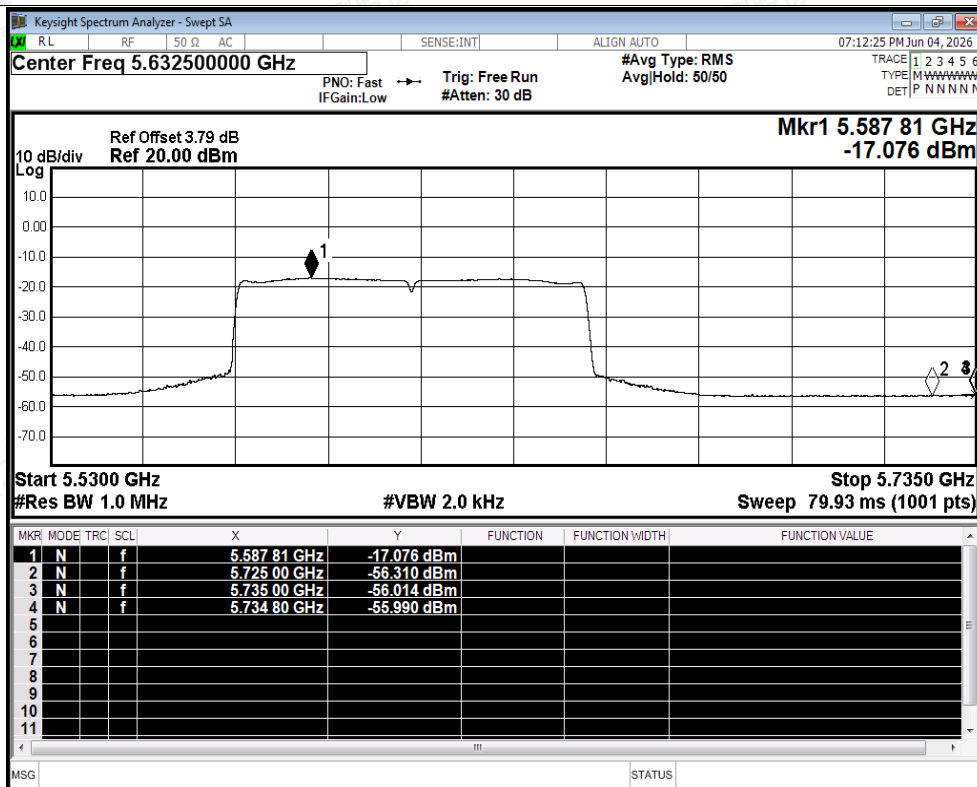

Restrict Band NVNT ac80 5610MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

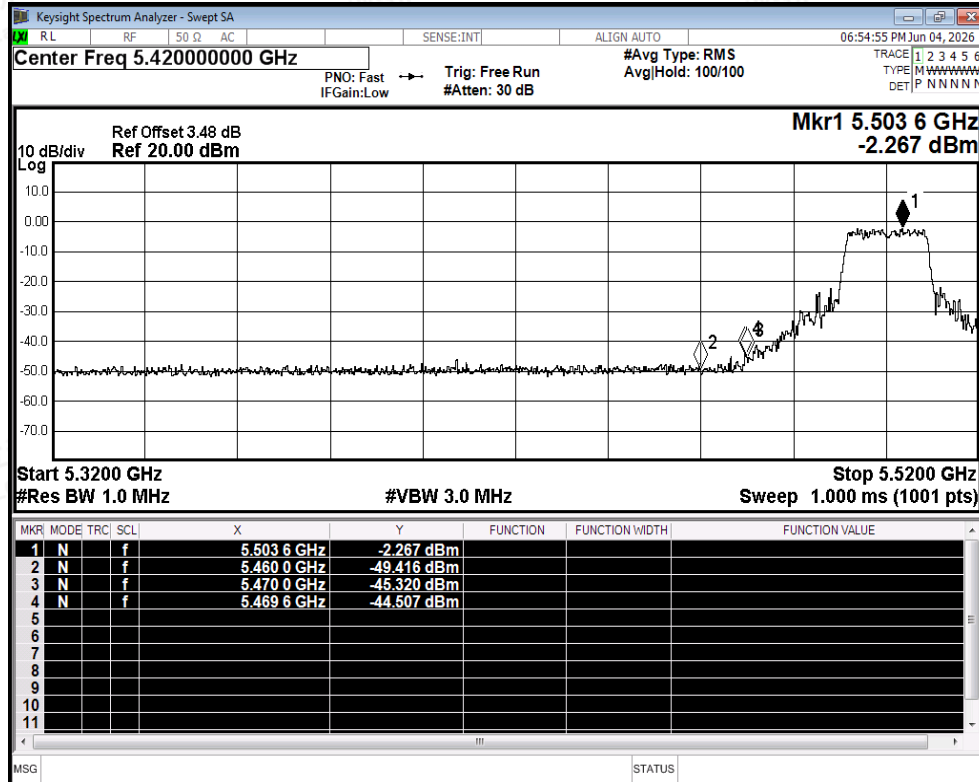

Restrict Band NVNT ax20 5500MHz Ant1 Peak

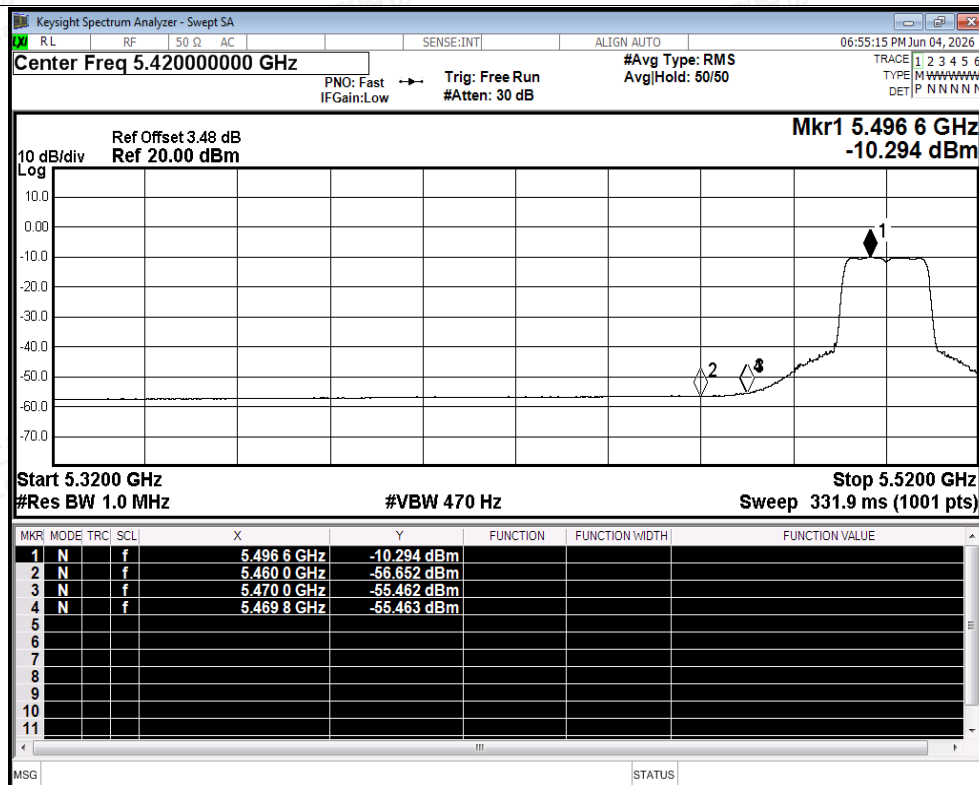

Restrict Band NVNT ax20 5500MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

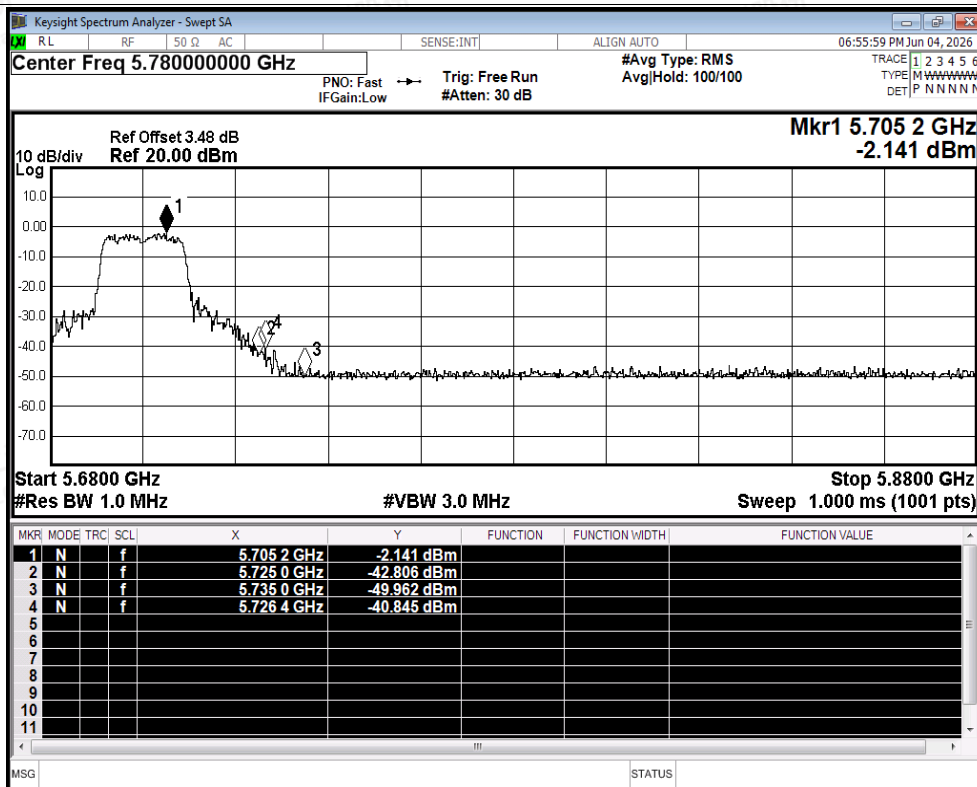

Restrict Band NVNT ax20 5700MHz Ant1 Peak

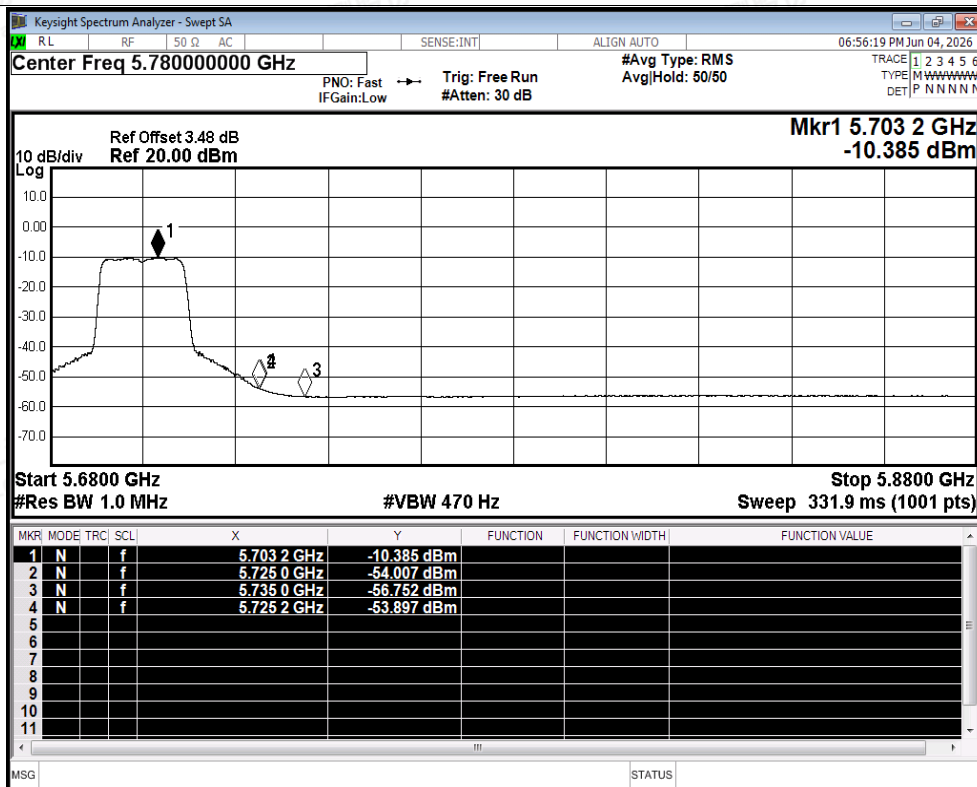

Restrict Band NVNT ax20 5700MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

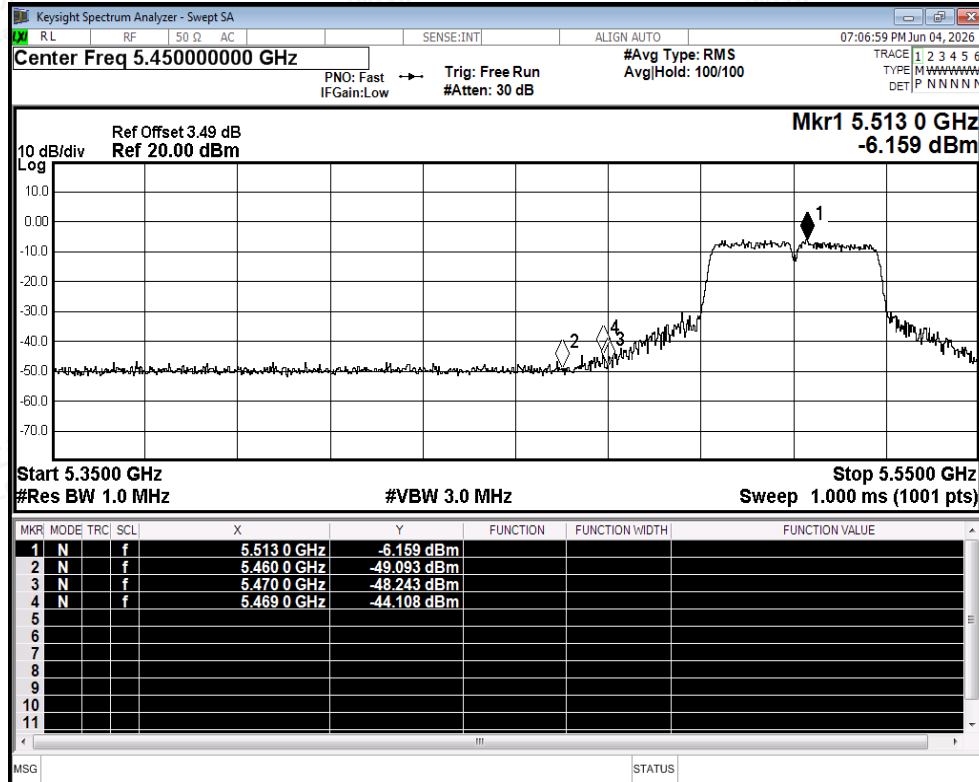

Restrict Band NVNT ax40 5510MHz Ant1 Peak

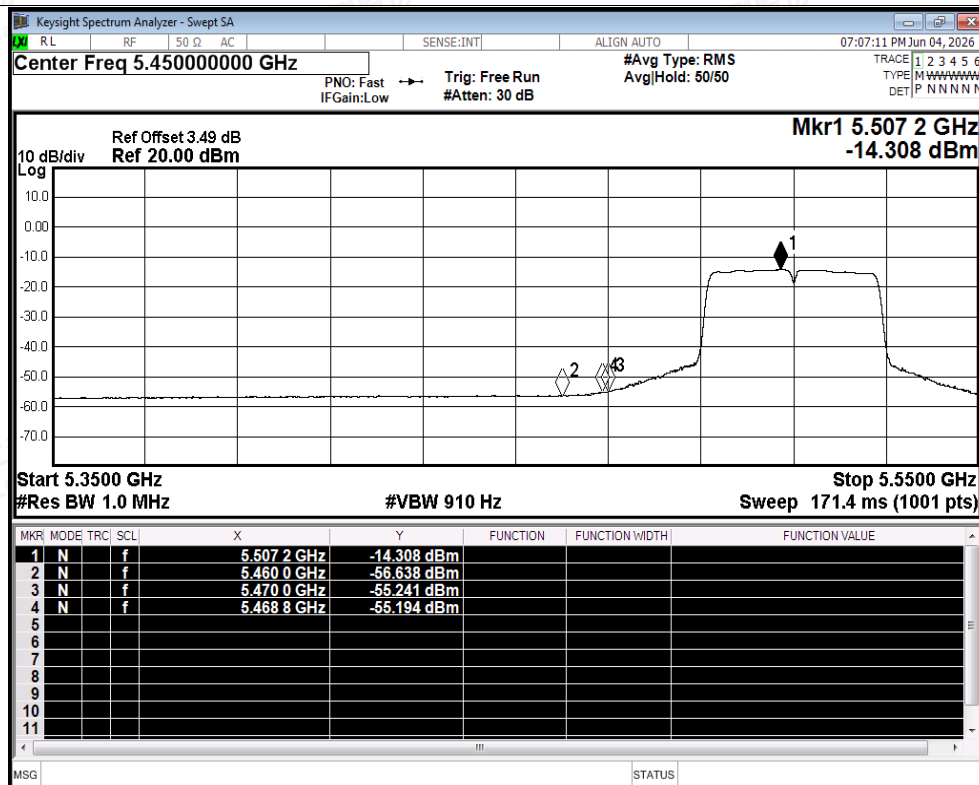

Restrict Band NVNT ax40 5510MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

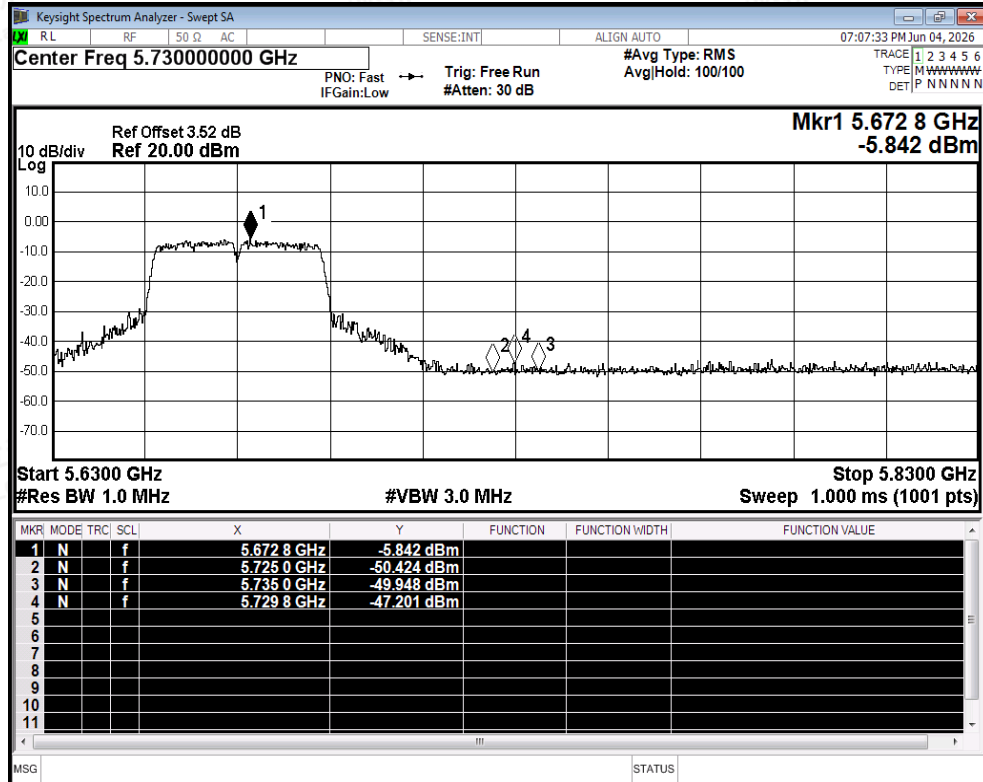

Restrict Band NVNT ax40 5670MHz Ant1 Peak

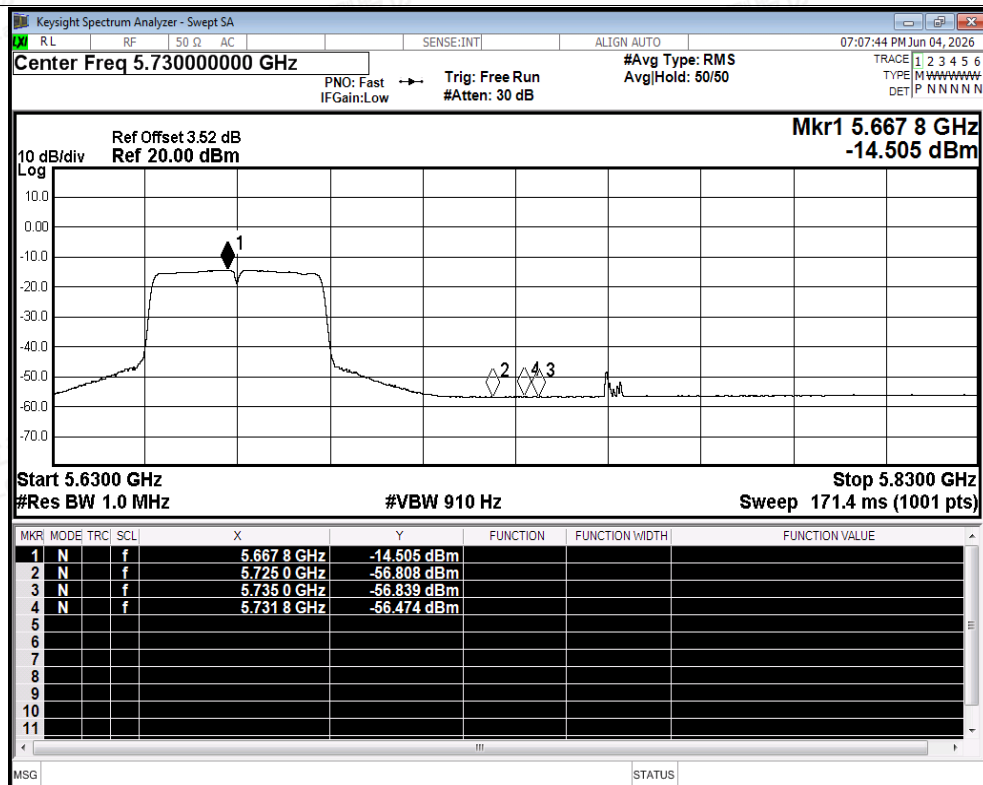

Restrict Band NVNT ax40 5670MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

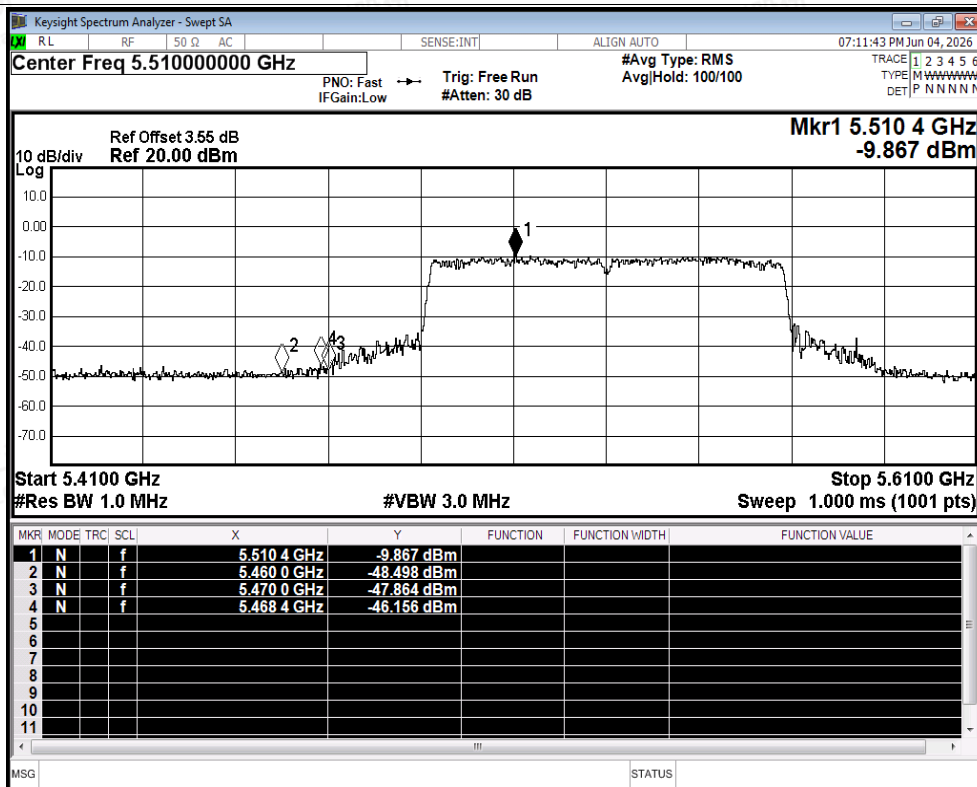

Restrict Band NVNT ax80 5530MHz Ant1 Peak

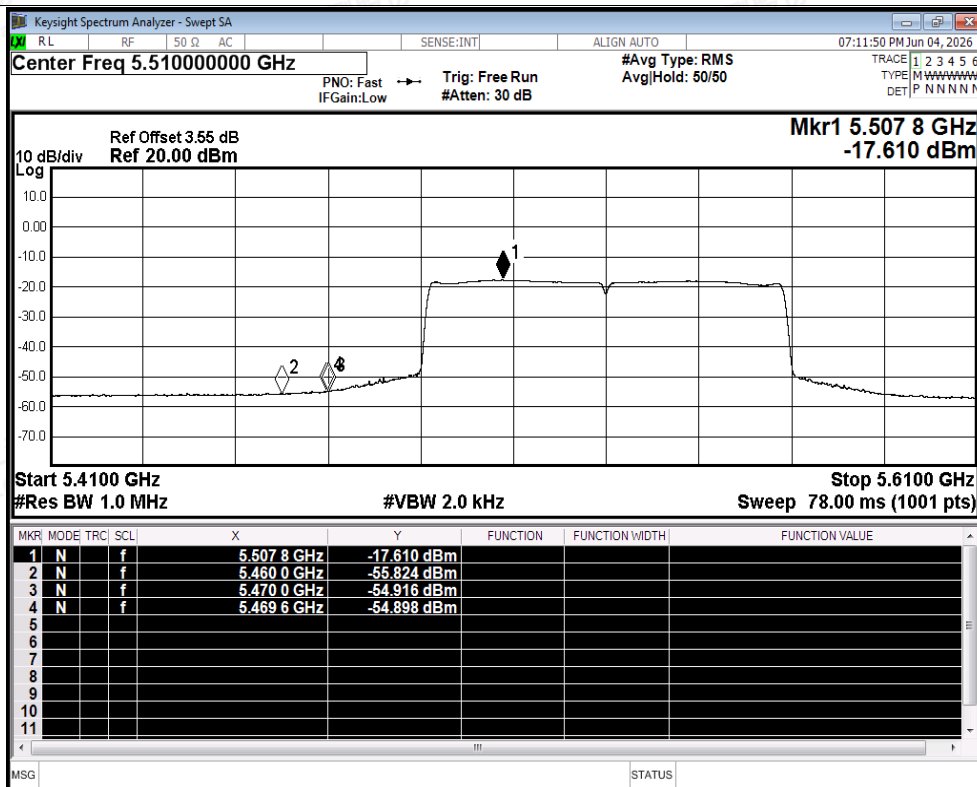

Restrict Band NVNT ax80 5530MHz Ant1 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

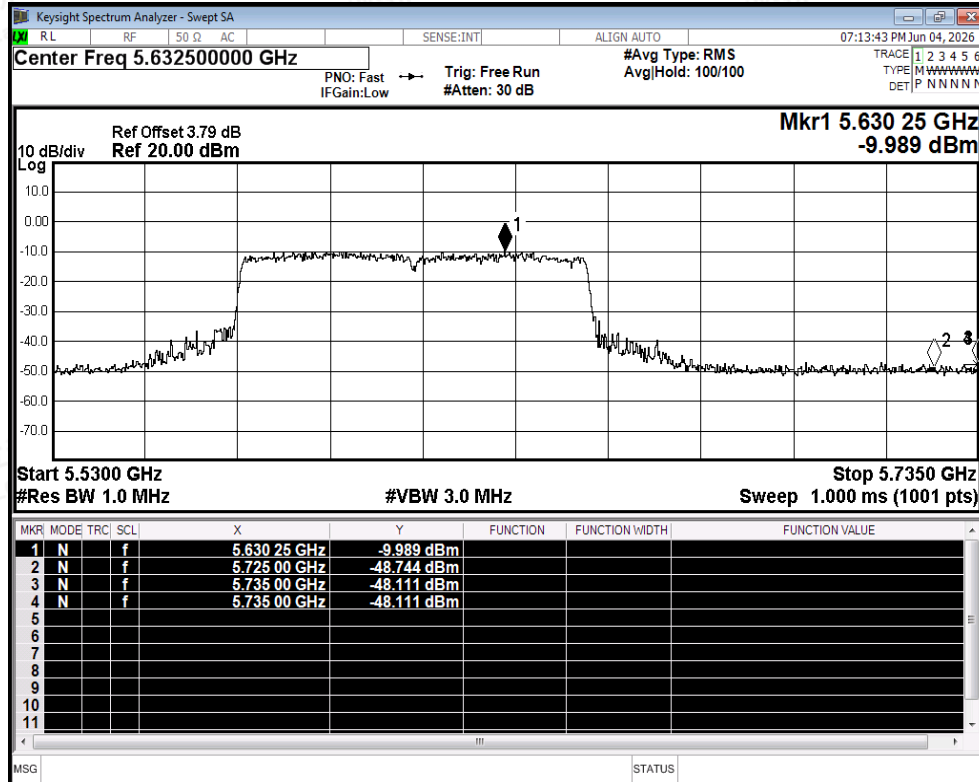

Restrict Band NVNT ax80 5610MHz Ant1 Peak

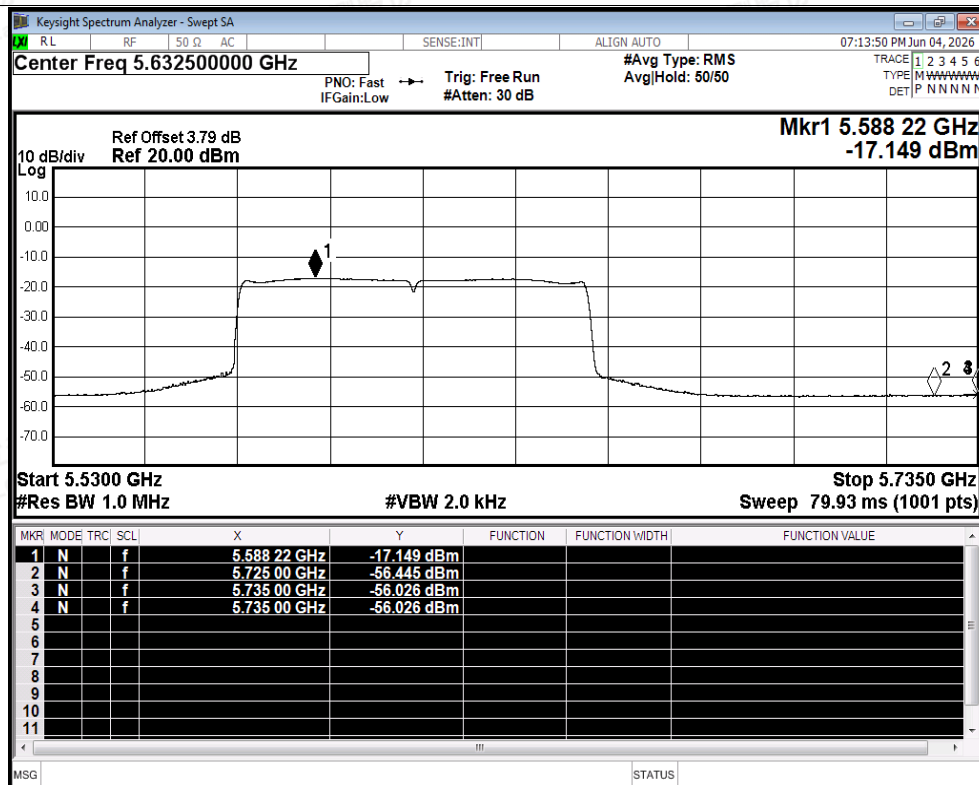

Restrict Band NVNT ax80 5610MHz Ant1 Average



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Restrict Band

Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5500	Ant2	5460	-49.55	2	47.71	Peak	68.2	Pass
NVNT	a	5500	Ant2	5460	-56.74	2	40.52	Average	54	Pass
NVNT	a	5500	Ant2	5469	-46.88	2	50.38	Peak	68.2	Pass
NVNT	a	5500	Ant2	5469.2	-56.11	2	41.15	Average	54	Pass
NVNT	a	5500	Ant2	5470	-50	2	47.26	Peak	68.2	Pass
NVNT	a	5500	Ant2	5470	-56.18	2	41.08	Average	54	Pass
NVNT	a	5700	Ant2	5725	-43.27	2	53.99	Peak	68.2	Pass
NVNT	a	5700	Ant2	5725	-54.77	2	42.49	Average	54	Pass
NVNT	a	5700	Ant2	5725.6	-40.09	2	57.17	Peak	68.2	Pass
NVNT	a	5700	Ant2	5725	-54.77	2	42.49	Average	54	Pass
NVNT	a	5700	Ant2	5735	-49.25	2	48.01	Peak	68.2	Pass
NVNT	a	5700	Ant2	5735	-56.79	2	40.47	Average	54	Pass
NVNT	n20	5500	Ant2	5460	-49.73	2	47.53	Peak	68.2	Pass
NVNT	n20	5500	Ant2	5460	-56.76	2	40.50	Average	54	Pass
NVNT	n20	5500	Ant2	5465.6	-46.35	2	50.91	Peak	68.2	Pass
NVNT	n20	5500	Ant2	5469.4	-55.75	2	41.51	Average	54	Pass
NVNT	n20	5500	Ant2	5470	-47.18	2	50.08	Peak	68.2	Pass
NVNT	n20	5500	Ant2	5470	-55.75	2	41.51	Average	54	Pass
NVNT	n20	5700	Ant2	5725	-41.34	2	55.92	Peak	68.2	Pass
NVNT	n20	5700	Ant2	5725	-54.09	2	43.17	Average	54	Pass
NVNT	n20	5700	Ant2	5725	-41.34	2	55.92	Peak	68.2	Pass
NVNT	n20	5700	Ant2	5725.2	-54.07	2	43.19	Average	54	Pass
NVNT	n20	5700	Ant2	5735	-48.77	2	48.49	Peak	68.2	Pass
NVNT	n20	5700	Ant2	5735	-56.81	2	40.45	Average	54	Pass
NVNT	n40	5510	Ant2	5460	-56.98	2	40.28	Peak	68.2	Pass
NVNT	n40	5510	Ant2	5460	-64.33	2	32.93	Average	54	Pass
NVNT	n40	5510	Ant2	5469	-45.24	2	52.02	Peak	68.2	Pass
NVNT	n40	5510	Ant2	5470	-59.24	2	38.02	Average	54	Pass
NVNT	n40	5510	Ant2	5470	-47.06	2	50.20	Peak	68.2	Pass
NVNT	n40	5510	Ant2	5470	-59.24	2	38.02	Average	54	Pass
NVNT	n40	5670	Ant2	5725	-49.51	2	47.75	Peak	68.2	Pass
NVNT	n40	5670	Ant2	5725	-56.91	2	40.35	Average	54	Pass
NVNT	n40	5670	Ant2	5731.4	-48.37	2	48.89	Peak	68.2	Pass
NVNT	n40	5670	Ant2	5726.4	-56.68	2	40.58	Average	54	Pass
NVNT	n40	5670	Ant2	5735	-49.94	2	47.32	Peak	68.2	Pass
NVNT	n40	5670	Ant2	5735	-56.93	2	40.33	Average	54	Pass
NVNT	ac20	5500	Ant2	5460	-50.26	2	47.00	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5500	Ant2	5460	-56.88	2	40.38	Average	54	Pass
NVNT	ac20	5500	Ant2	5467.6	-46.13	2	51.13	Peak	68.2	Pass
NVNT	ac20	5500	Ant2	5470	-55.67	2	41.59	Average	54	Pass
NVNT	ac20	5500	Ant2	5470	-47.82	2	49.44	Peak	68.2	Pass
NVNT	ac20	5500	Ant2	5470	-55.67	2	41.59	Average	54	Pass
NVNT	ac20	5700	Ant2	5725	-39.77	2	57.49	Peak	68.2	Pass
NVNT	ac20	5700	Ant2	5725	-53.87	2	43.39	Average	54	Pass
NVNT	ac20	5700	Ant2	5725	-39.77	2	57.49	Peak	68.2	Pass
NVNT	ac20	5700	Ant2	5725	-53.87	2	43.39	Average	54	Pass
NVNT	ac20	5700	Ant2	5735	-49.45	2	47.81	Peak	68.2	Pass
NVNT	ac20	5700	Ant2	5735	-56.79	2	40.47	Average	54	Pass
NVNT	ac40	5510	Ant2	5460	-56.36	2	40.90	Peak	68.2	Pass
NVNT	ac40	5510	Ant2	5460	-64.52	2	32.74	Average	54	Pass
NVNT	ac40	5510	Ant2	5467	-43.98	2	53.28	Peak	68.2	Pass
NVNT	ac40	5510	Ant2	5470	-59.13	2	38.13	Average	54	Pass
NVNT	ac40	5510	Ant2	5470	-45.2	2	52.06	Peak	68.2	Pass
NVNT	ac40	5510	Ant2	5470	-59.13	2	38.13	Average	54	Pass
NVNT	ac40	5670	Ant2	5725	-51.33	2	45.93	Peak	68.2	Pass
NVNT	ac40	5670	Ant2	5725	-56.96	2	40.30	Average	54	Pass
NVNT	ac40	5670	Ant2	5729.2	-47.13	2	50.13	Peak	68.2	Pass
NVNT	ac40	5670	Ant2	5728	-56.7	2	40.56	Average	54	Pass
NVNT	ac40	5670	Ant2	5735	-48.59	2	48.67	Peak	68.2	Pass
NVNT	ac40	5670	Ant2	5735	-56.99	2	40.27	Average	54	Pass
NVNT	ac80	5530	Ant2	5460	-49.88	2	47.38	Peak	68.2	Pass
NVNT	ac80	5530	Ant2	5460	-56.35	2	40.91	Average	54	Pass
NVNT	ac80	5530	Ant2	5464.2	-44.09	2	53.17	Peak	68.2	Pass
NVNT	ac80	5530	Ant2	5467.4	-54.98	2	42.28	Average	54	Pass
NVNT	ac80	5530	Ant2	5470	-46.84	2	50.42	Peak	68.2	Pass
NVNT	ac80	5530	Ant2	5470	-55.18	2	42.08	Average	54	Pass
NVNT	ac80	5610	Ant2	5725	-48.75	2	48.51	Peak	68.2	Pass
NVNT	ac80	5610	Ant2	5725	-56.34	2	40.92	Average	54	Pass
NVNT	ac80	5610	Ant2	5735	-46.24	2	51.02	Peak	68.2	Pass
NVNT	ac80	5610	Ant2	5725.775	-56.16	2	41.10	Average	54	Pass
NVNT	ac80	5610	Ant2	5735	-46.24	2	51.02	Peak	68.2	Pass
NVNT	ac80	5610	Ant2	5735	-56.27	2	40.99	Average	54	Pass
NVNT	ax20	5500	Ant2	5460	-50.64	2	46.62	Peak	68.2	Pass
NVNT	ax20	5500	Ant2	5460	-56.66	2	40.60	Average	54	Pass
NVNT	ax20	5500	Ant2	5469.4	-44.55	2	52.71	Peak	68.2	Pass
NVNT	ax20	5500	Ant2	5469.8	-55.55	2	41.71	Average	54	Pass
NVNT	ax20	5500	Ant2	5470	-46.43	2	50.83	Peak	68.2	Pass
NVNT	ax20	5500	Ant2	5470	-55.61	2	41.65	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax20	5700	Ant2	5725	-39.94	2	57.32	Peak	68.2	Pass
NVNT	ax20	5700	Ant2	5725	-54.17	2	43.09	Average	54	Pass
NVNT	ax20	5700	Ant2	5725	-39.94	2	57.32	Peak	68.2	Pass
NVNT	ax20	5700	Ant2	5725.2	-54.08	2	43.18	Average	54	Pass
NVNT	ax20	5700	Ant2	5735	-49.78	2	47.48	Peak	68.2	Pass
NVNT	ax20	5700	Ant2	5735	-56.78	2	40.48	Average	54	Pass
NVNT	ax40	5510	Ant2	5460	-49.35	2	47.91	Peak	68.2	Pass
NVNT	ax40	5510	Ant2	5460	-56.74	2	40.52	Average	54	Pass
NVNT	ax40	5510	Ant2	5469.8	-44.29	2	52.97	Peak	68.2	Pass
NVNT	ax40	5510	Ant2	5470	-55.17	2	42.09	Average	54	Pass
NVNT	ax40	5510	Ant2	5470	-45.18	2	52.08	Peak	68.2	Pass
NVNT	ax40	5510	Ant2	5470	-55.17	2	42.09	Average	54	Pass
NVNT	ax40	5670	Ant2	5725	-49.97	2	47.29	Peak	68.2	Pass
NVNT	ax40	5670	Ant2	5725	-56.96	2	40.30	Average	54	Pass
NVNT	ax40	5670	Ant2	5729.2	-47.79	2	49.47	Peak	68.2	Pass
NVNT	ax40	5670	Ant2	5725.8	-56.65	2	40.61	Average	54	Pass
NVNT	ax40	5670	Ant2	5735	-50.57	2	46.69	Peak	68.2	Pass
NVNT	ax40	5670	Ant2	5735	-56.87	2	40.39	Average	54	Pass
NVNT	ax80	5530	Ant2	5460	-49.75	2	47.51	Peak	68.2	Pass
NVNT	ax80	5530	Ant2	5460	-56.03	2	41.23	Average	54	Pass
NVNT	ax80	5530	Ant2	5465.6	-45.56	2	51.70	Peak	68.2	Pass
NVNT	ax80	5530	Ant2	5469.6	-54.73	2	42.53	Average	54	Pass
NVNT	ax80	5530	Ant2	5470	-46.41	2	50.85	Peak	68.2	Pass
NVNT	ax80	5530	Ant2	5470	-55.06	2	42.20	Average	54	Pass
NVNT	ax80	5610	Ant2	5725	-50.28	2	46.98	Peak	68.2	Pass
NVNT	ax80	5610	Ant2	5725	-56.58	2	40.68	Average	54	Pass
NVNT	ax80	5610	Ant2	5730.285	-46.69	2	50.57	Peak	68.2	Pass
NVNT	ax80	5610	Ant2	5731.31	-56.21	2	41.05	Average	54	Pass
NVNT	ax80	5610	Ant2	5735	-48.1	2	49.16	Peak	68.2	Pass
NVNT	ax80	5610	Ant2	5735	-56.3	2	40.96	Average	54	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

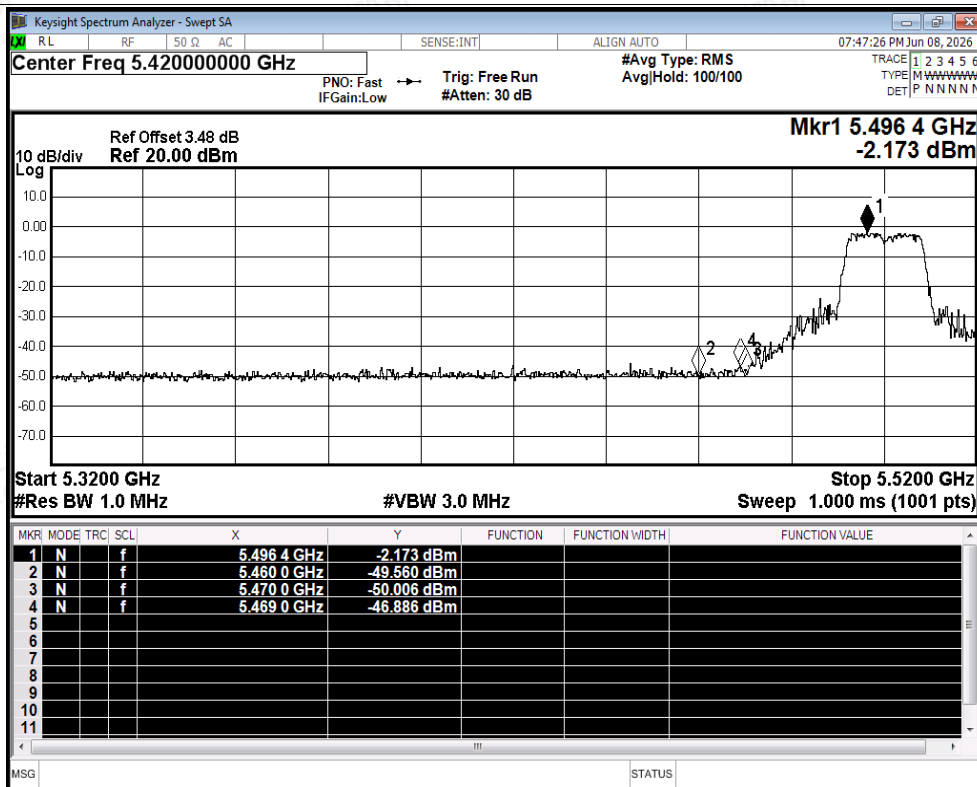

Restrict Band NVNT a 5500MHz Ant2 Peak

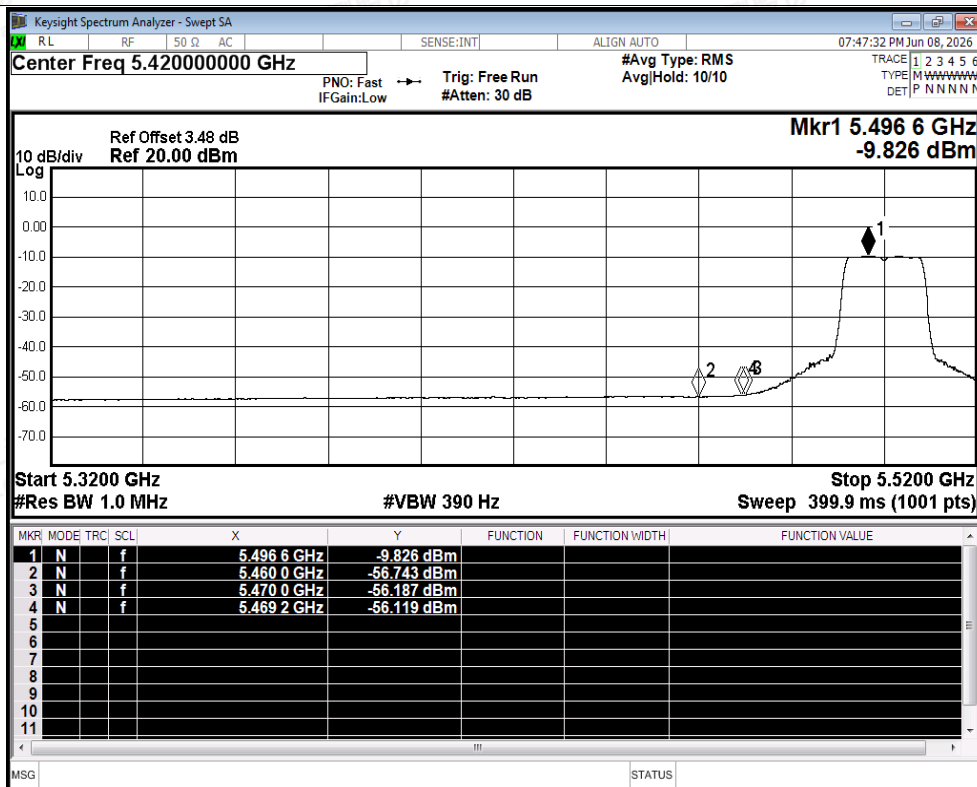

Restrict Band NVNT a 5500MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

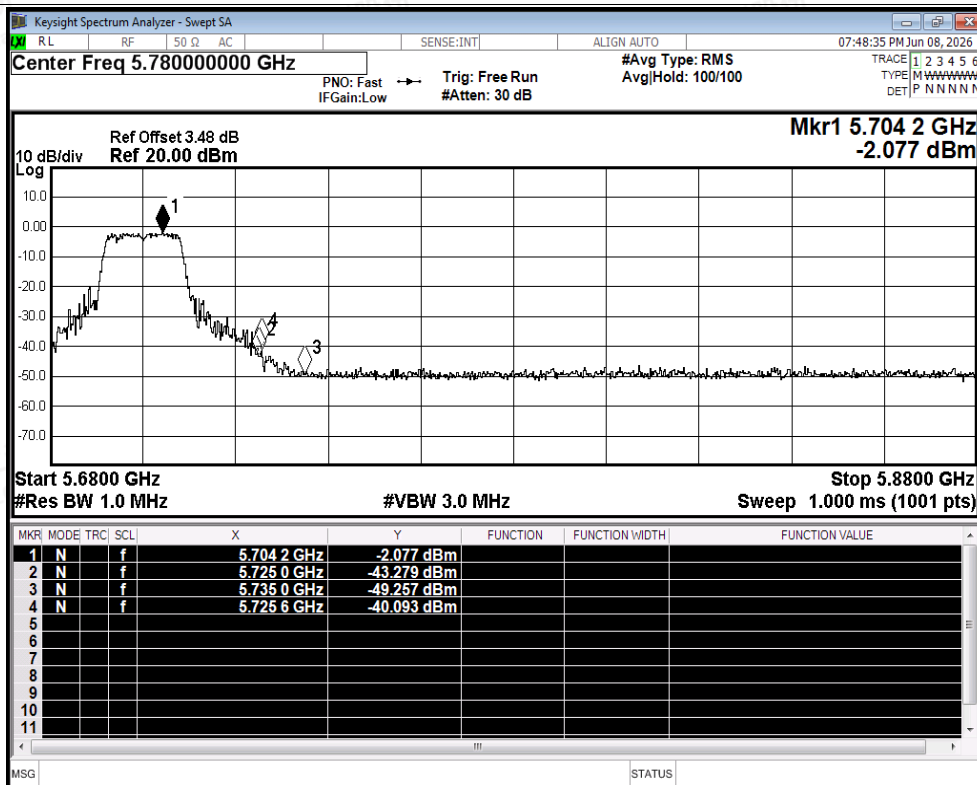

Restrict Band NVNT a 5700MHz Ant2 Peak

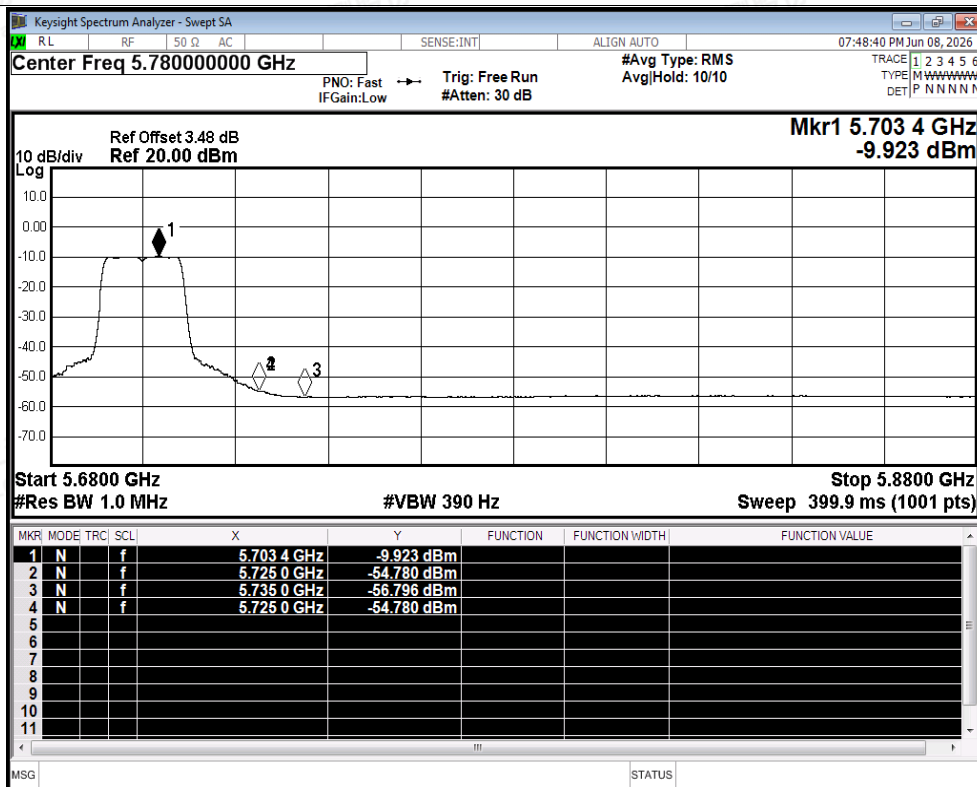

Restrict Band NVNT a 5700MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

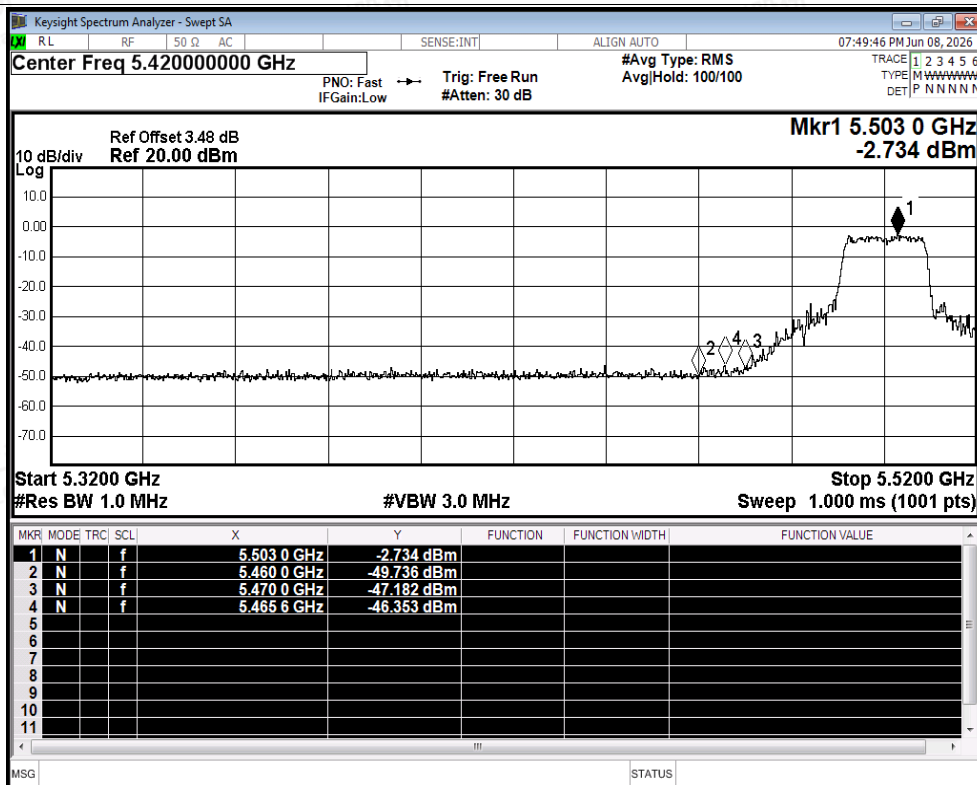

Restrict Band NVNT n20 5500MHz Ant2 Peak

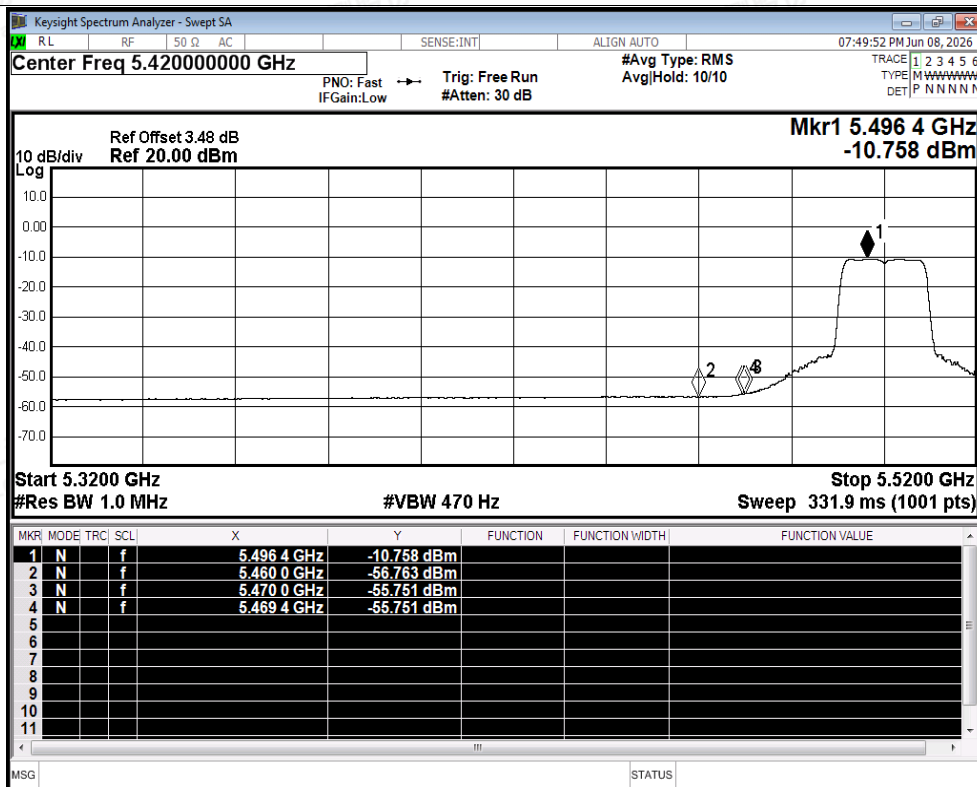

Restrict Band NVNT n20 5500MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

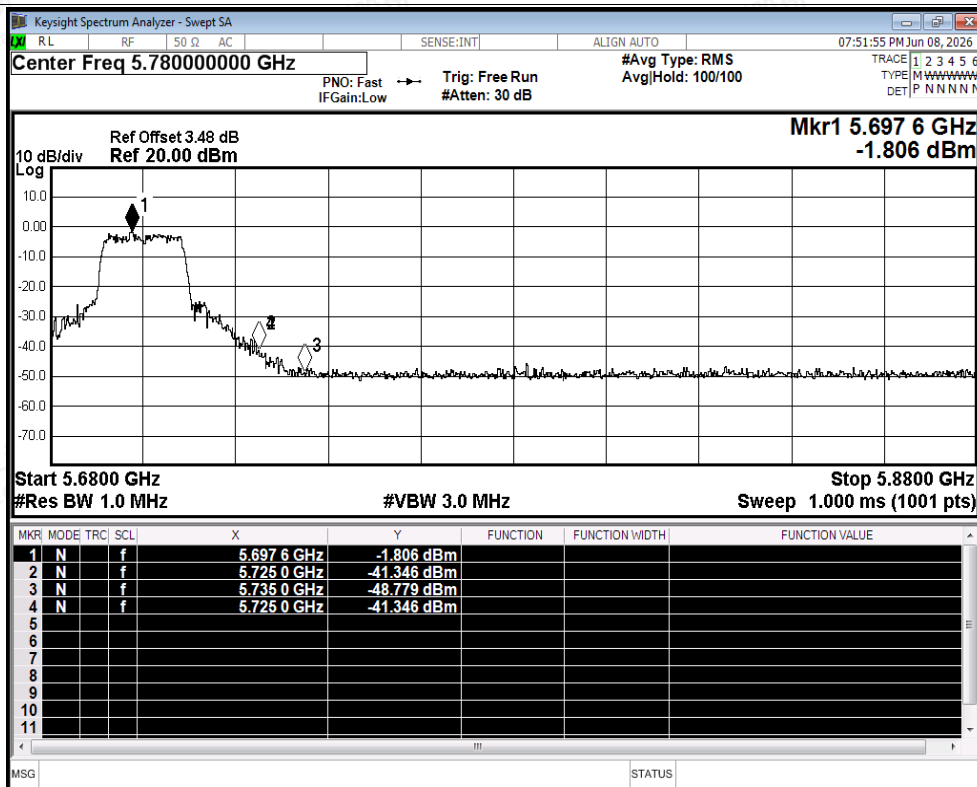

Restrict Band NVNT n20 5700MHz Ant2 Peak

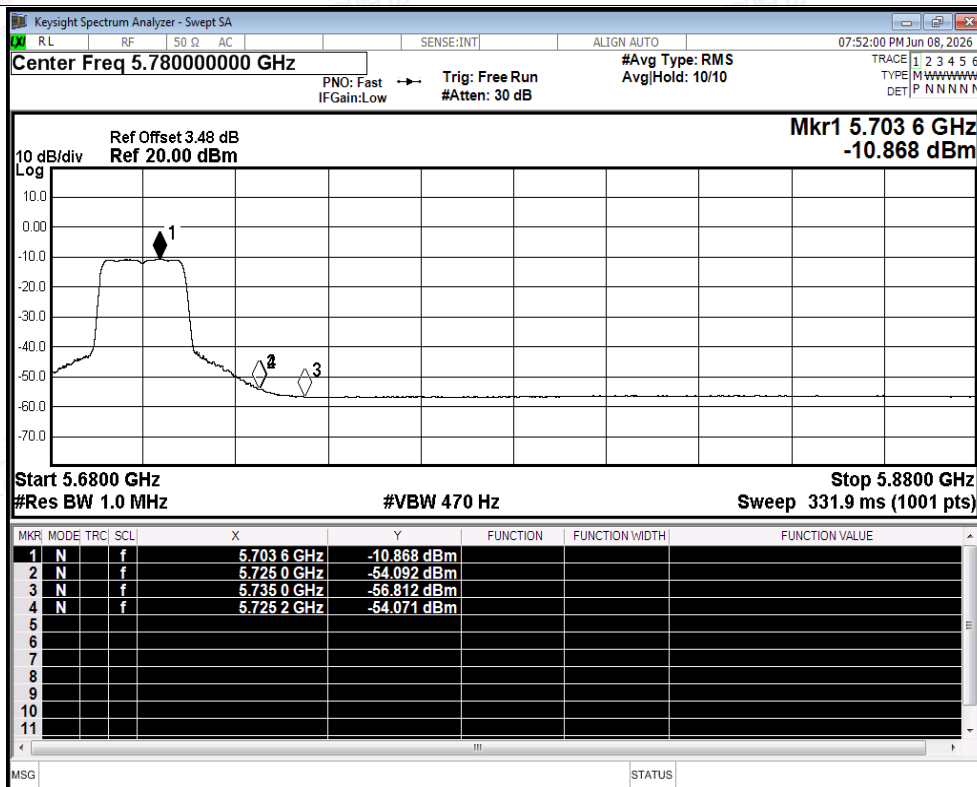

Restrict Band NVNT n20 5700MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

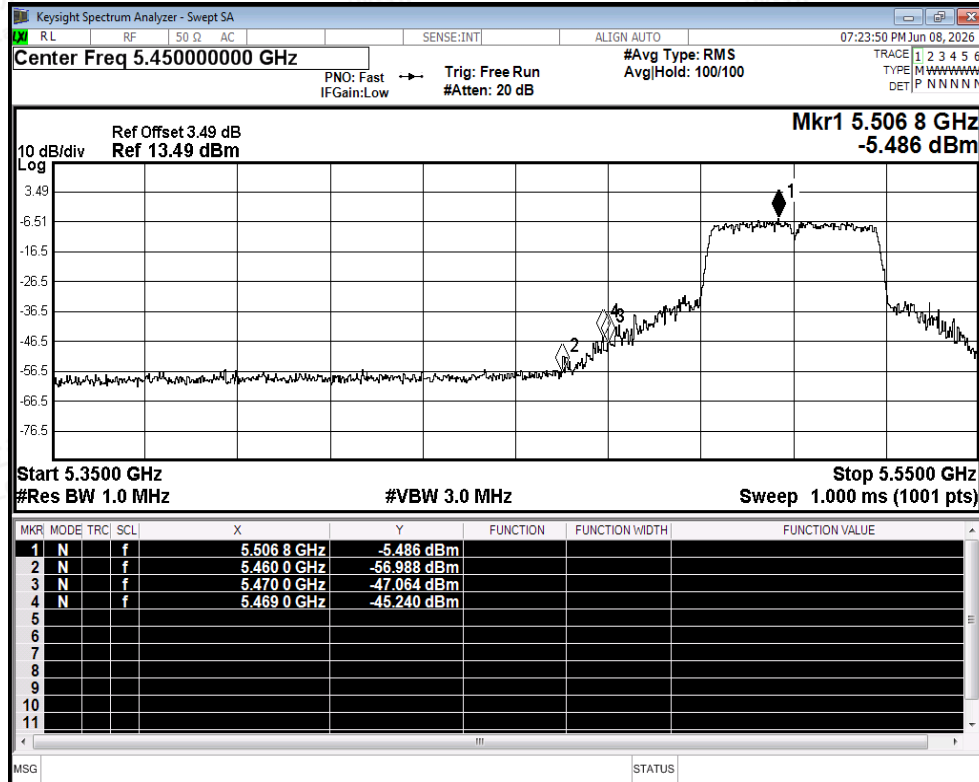

Restrict Band NVNT n40 5510MHz Ant2 Peak

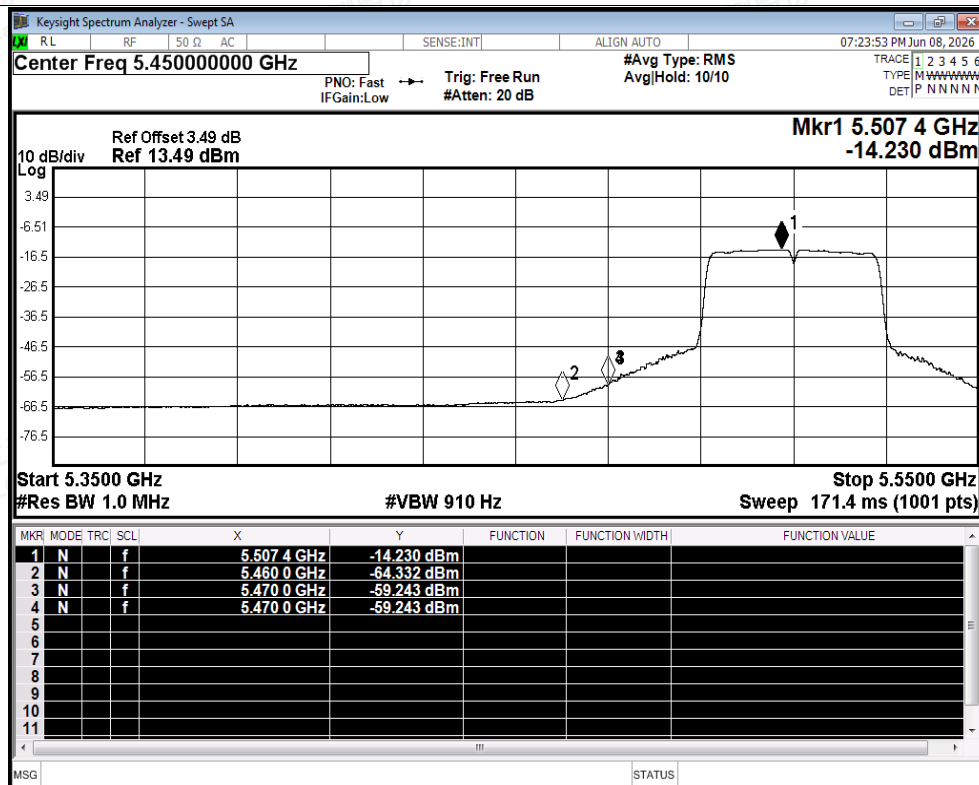

Restrict Band NVNT n40 5510MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

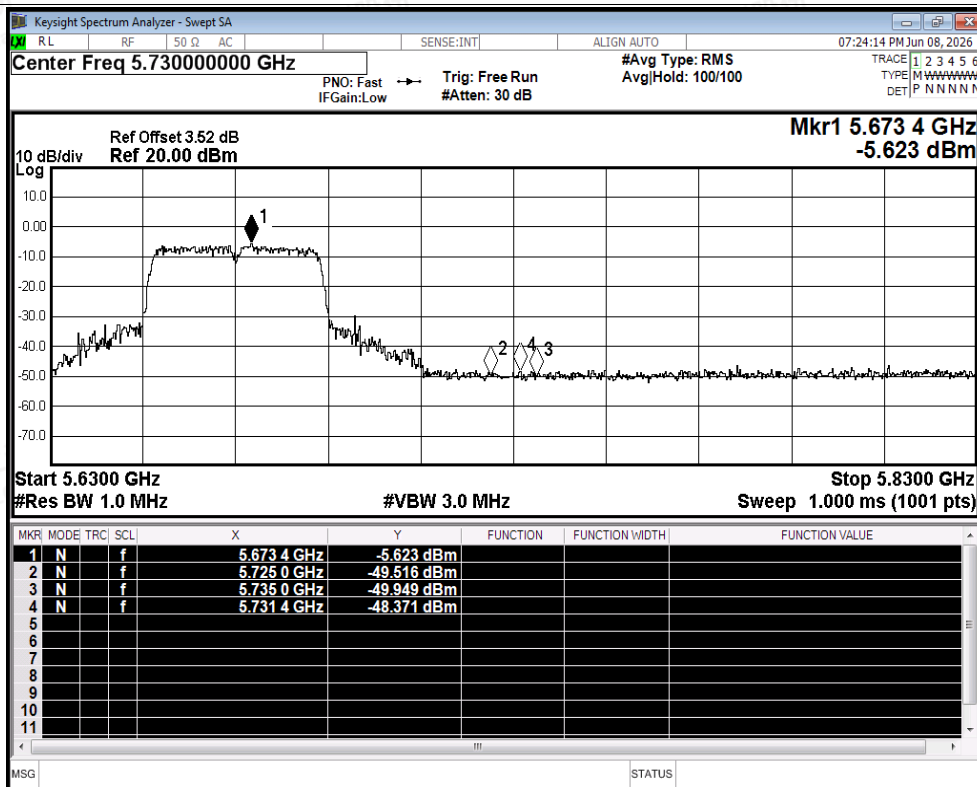

Restrict Band NVNT n40 5670MHz Ant2 Peak

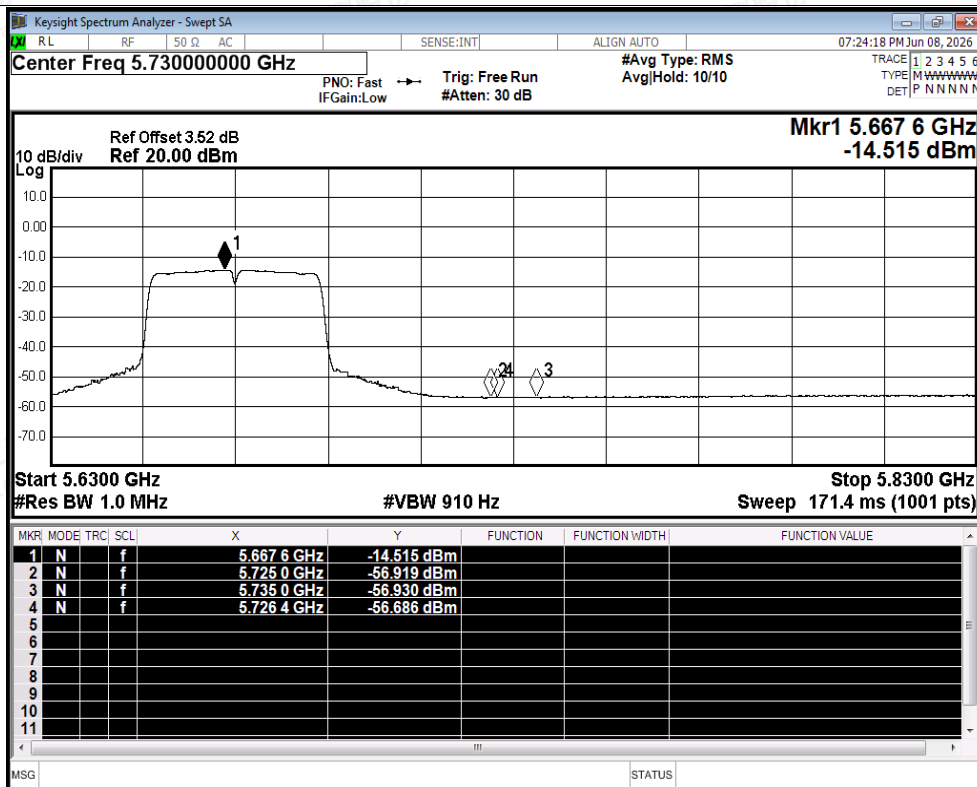

Restrict Band NVNT n40 5670MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

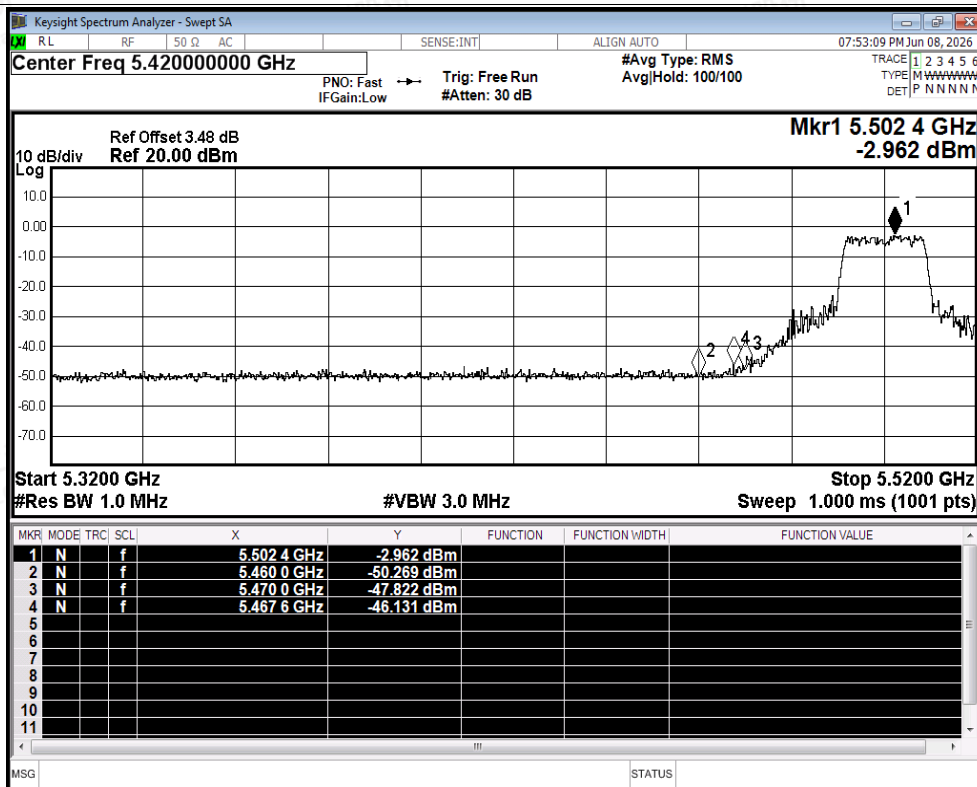

Restrict Band NVNT ac20 5500MHz Ant2 Peak

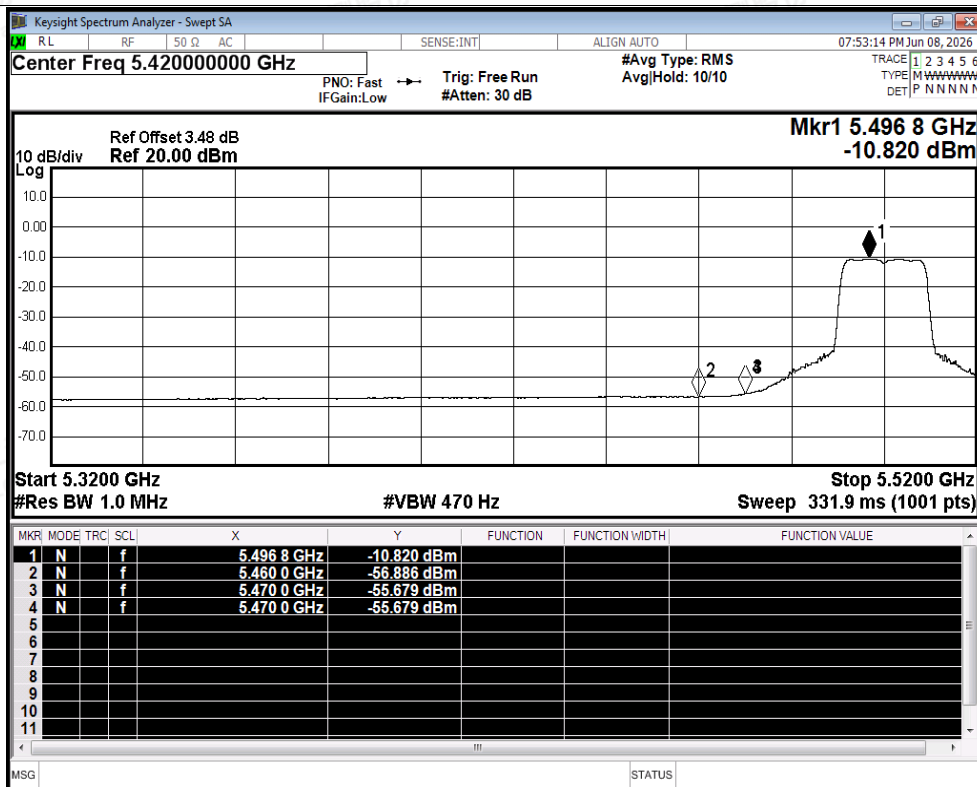

Restrict Band NVNT ac20 5500MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

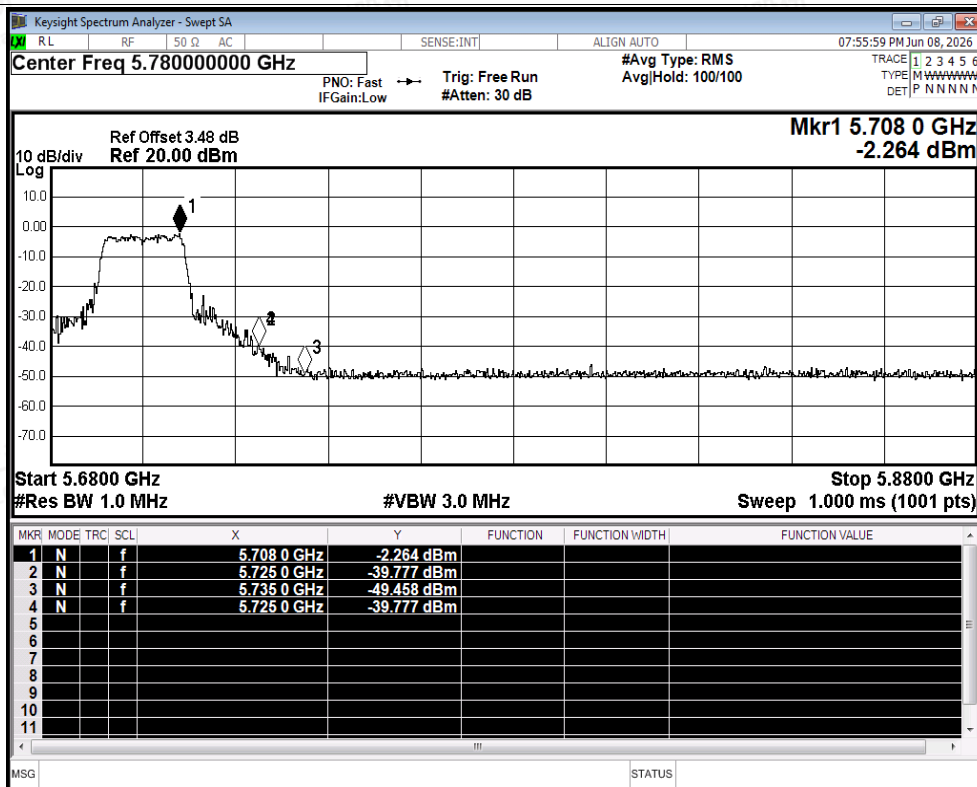

Restrict Band NVNT ac20 5700MHz Ant2 Peak

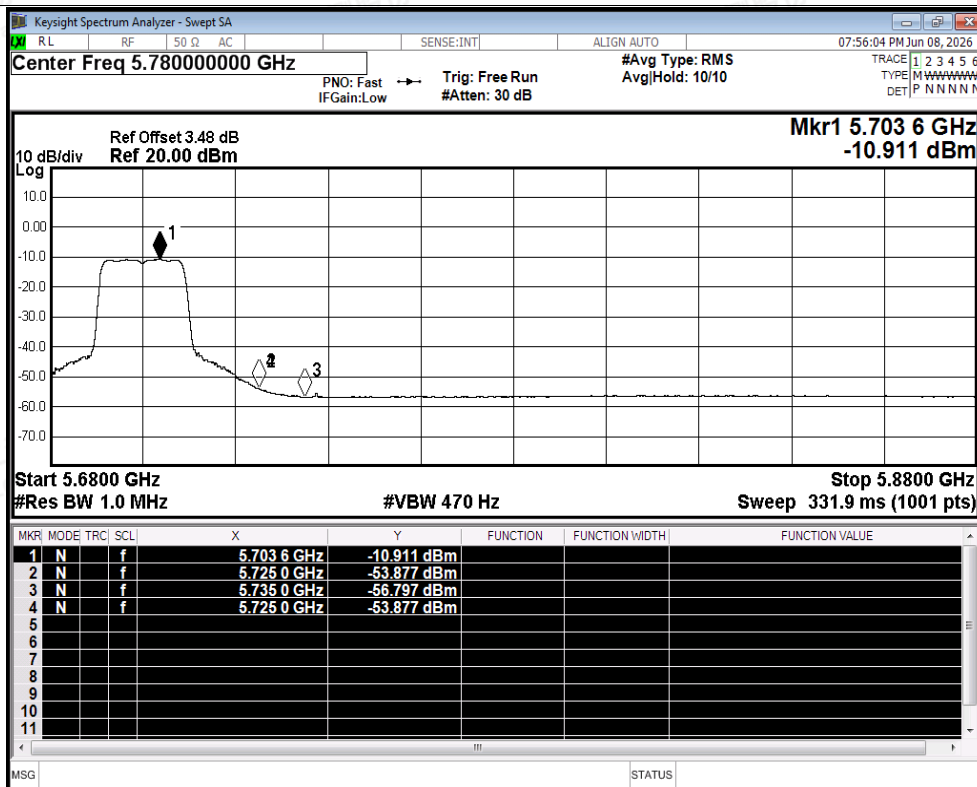

Restrict Band NVNT ac20 5700MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

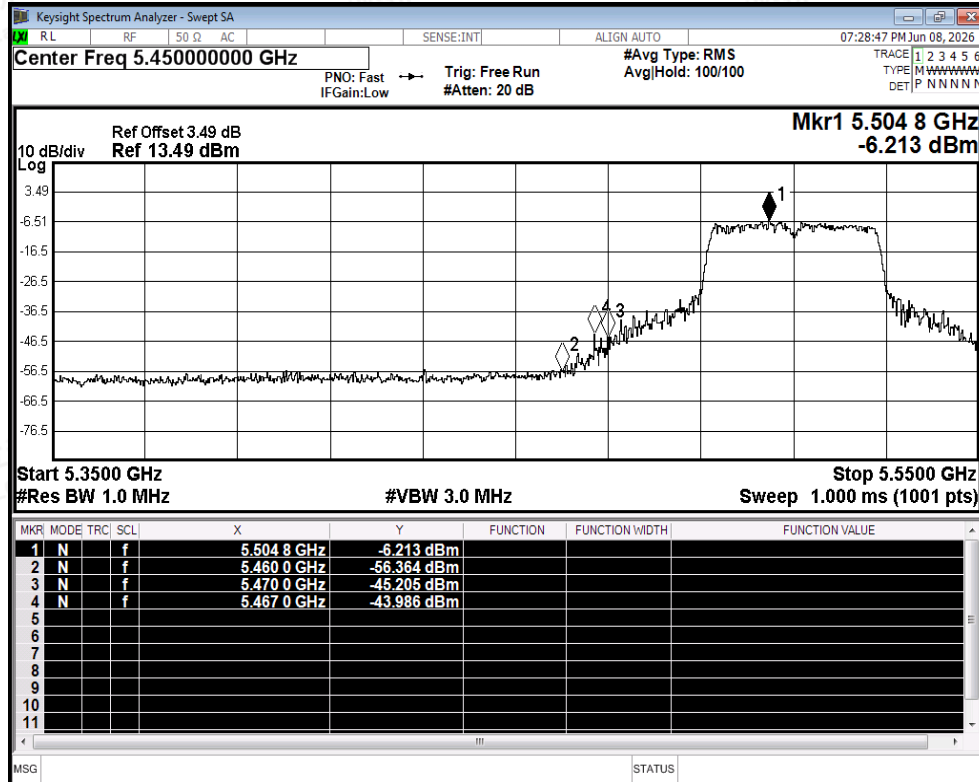

Restrict Band NVNT ac40 5510MHz Ant2 Peak

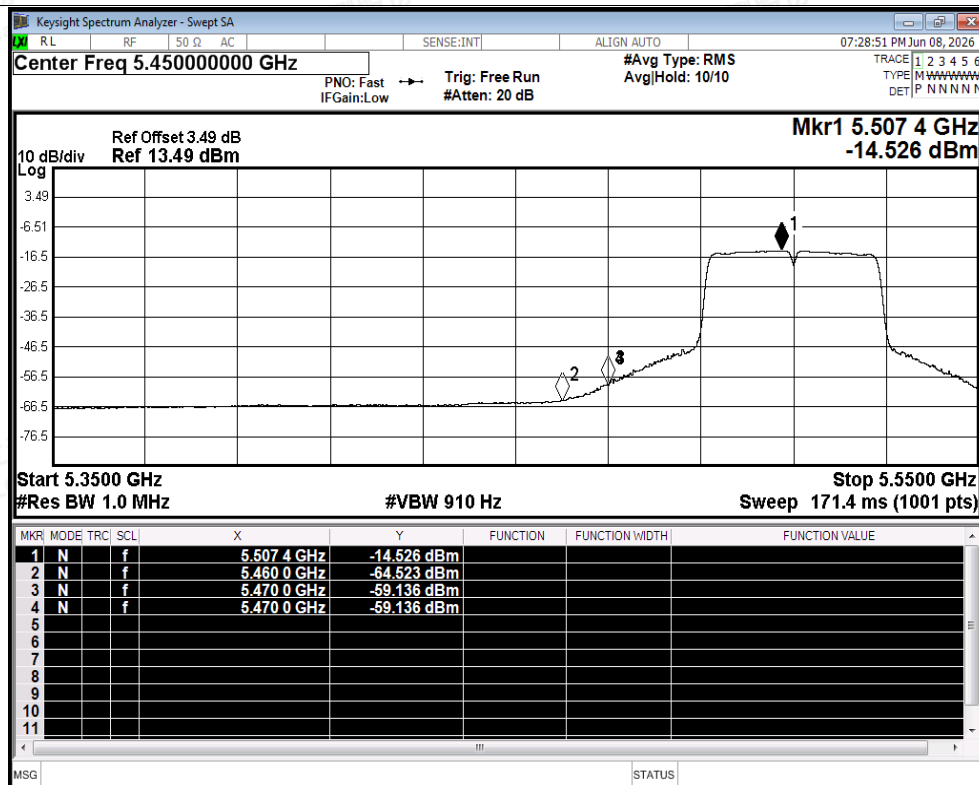

Restrict Band NVNT ac40 5510MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

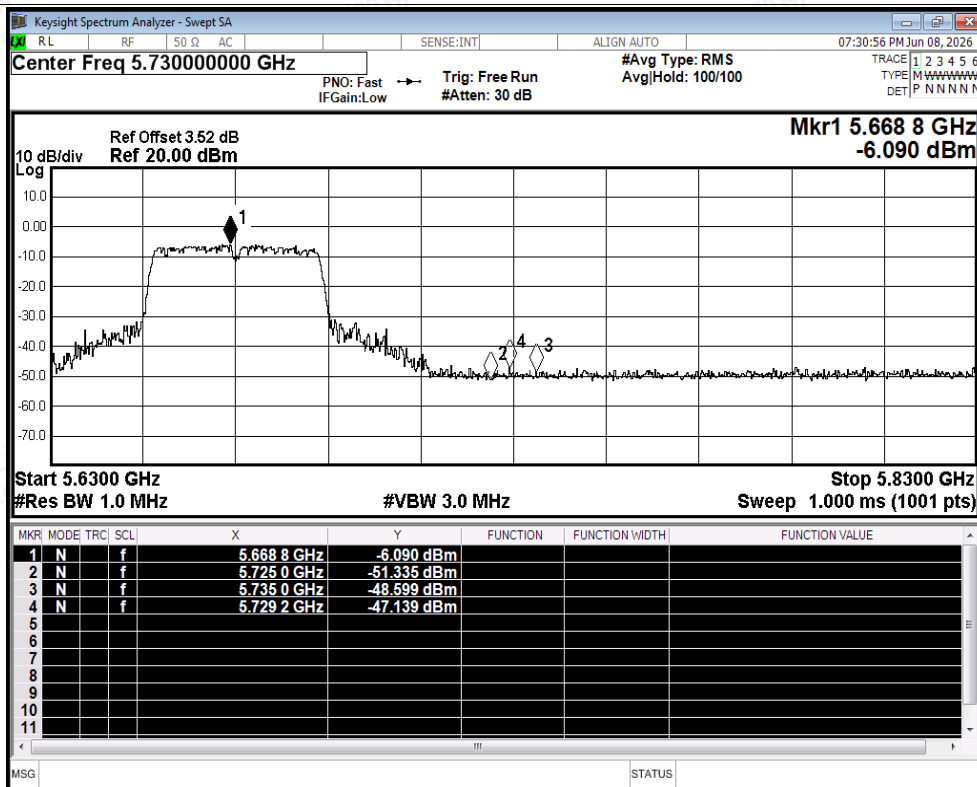

Restrict Band NVNT ac40 5670MHz Ant2 Peak

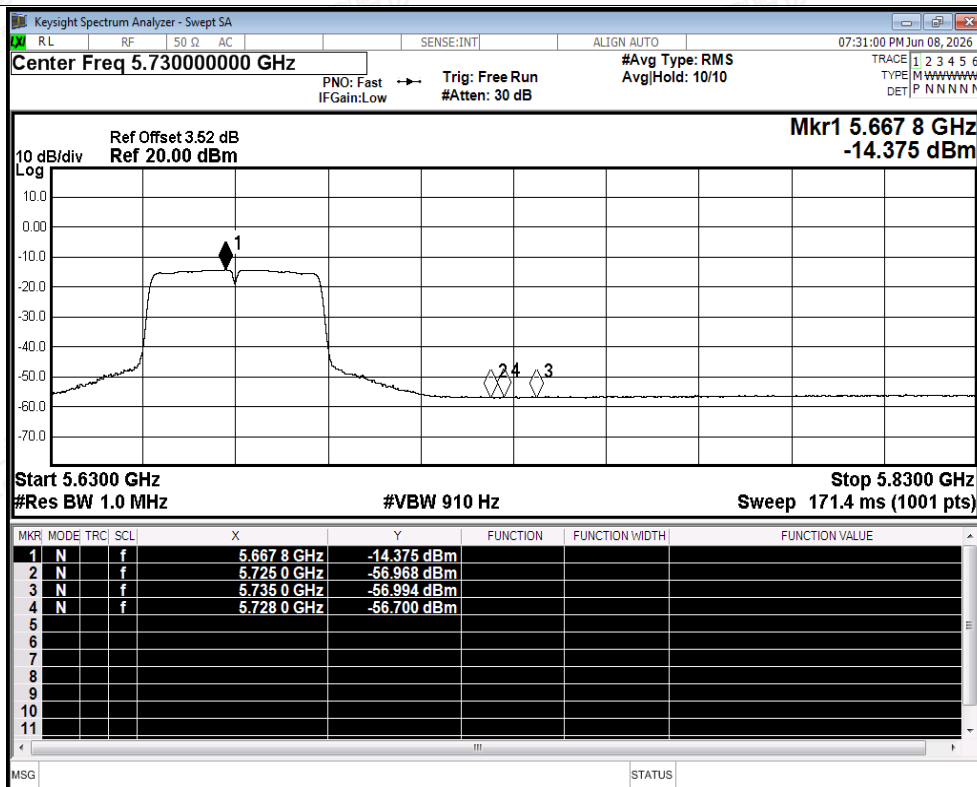

Restrict Band NVNT ac40 5670MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

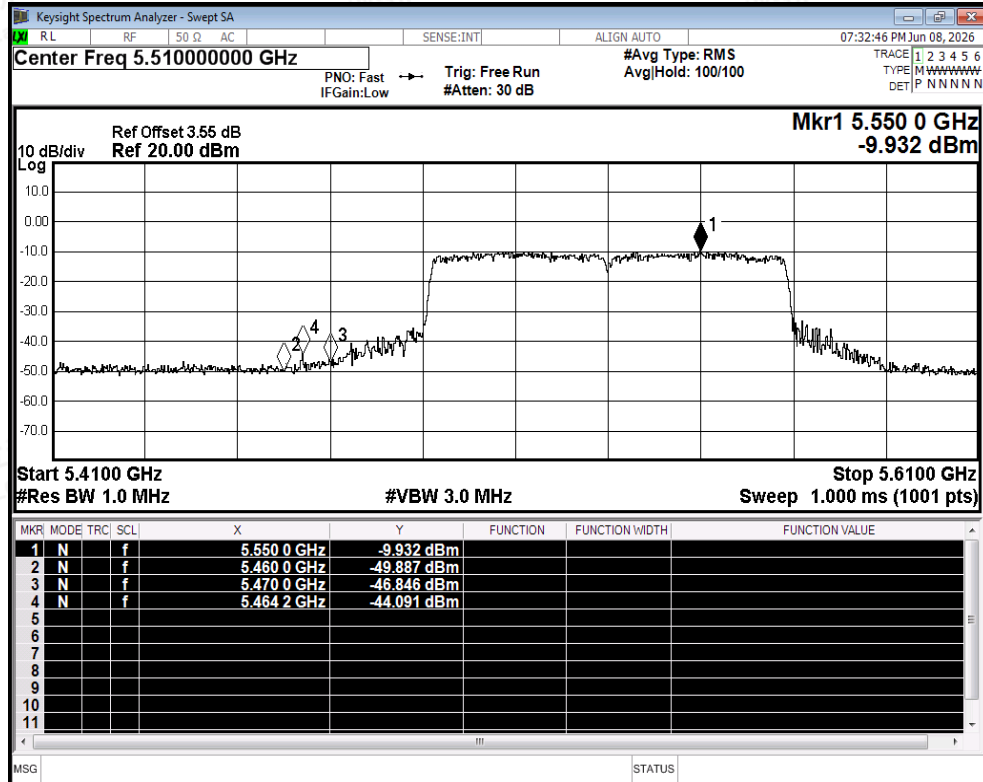

Restrict Band NVNT ac80 5530MHz Ant2 Peak

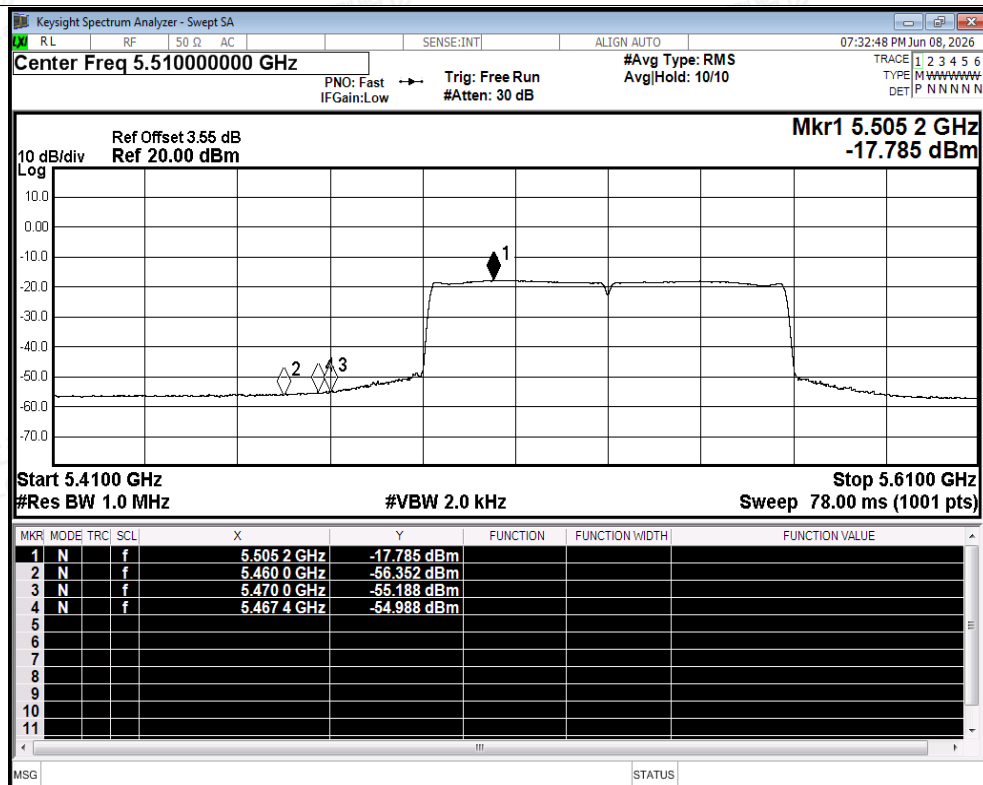

Restrict Band NVNT ac80 5530MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

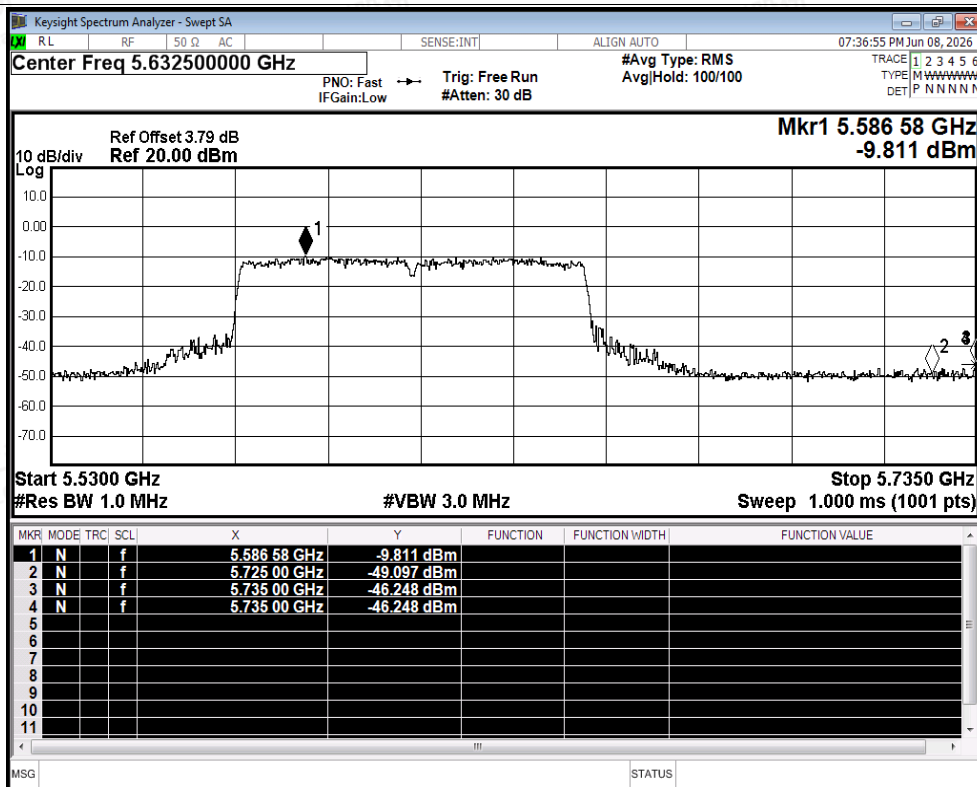

Restrict Band NVNT ac80 5610MHz Ant2 Peak

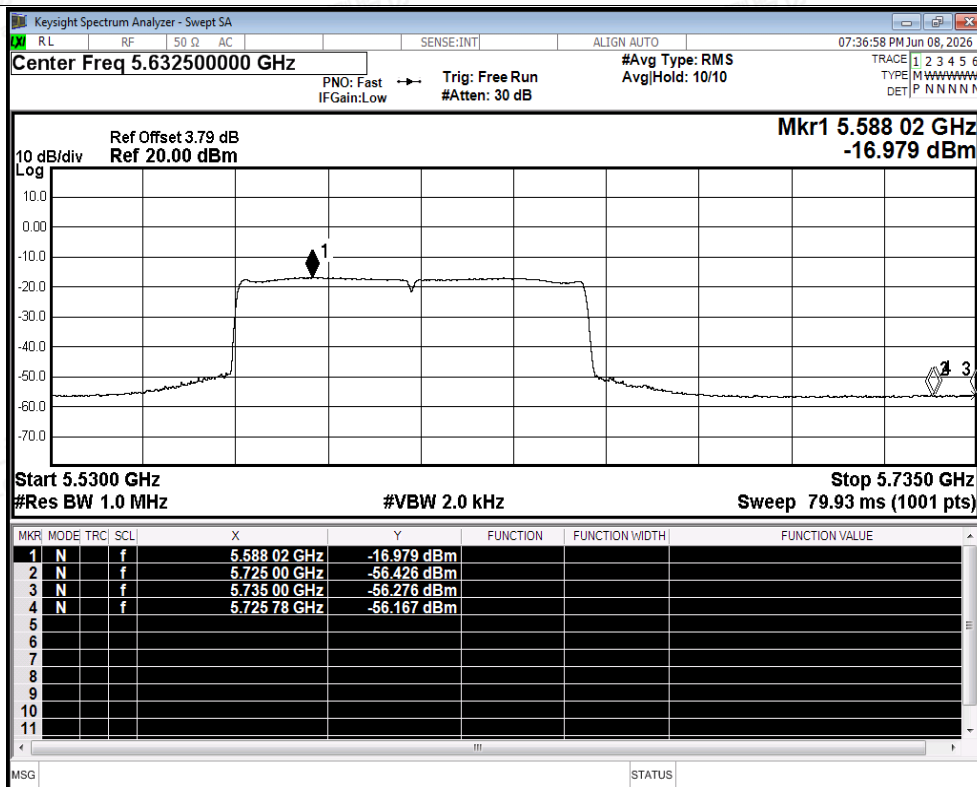

Restrict Band NVNT ac80 5610MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

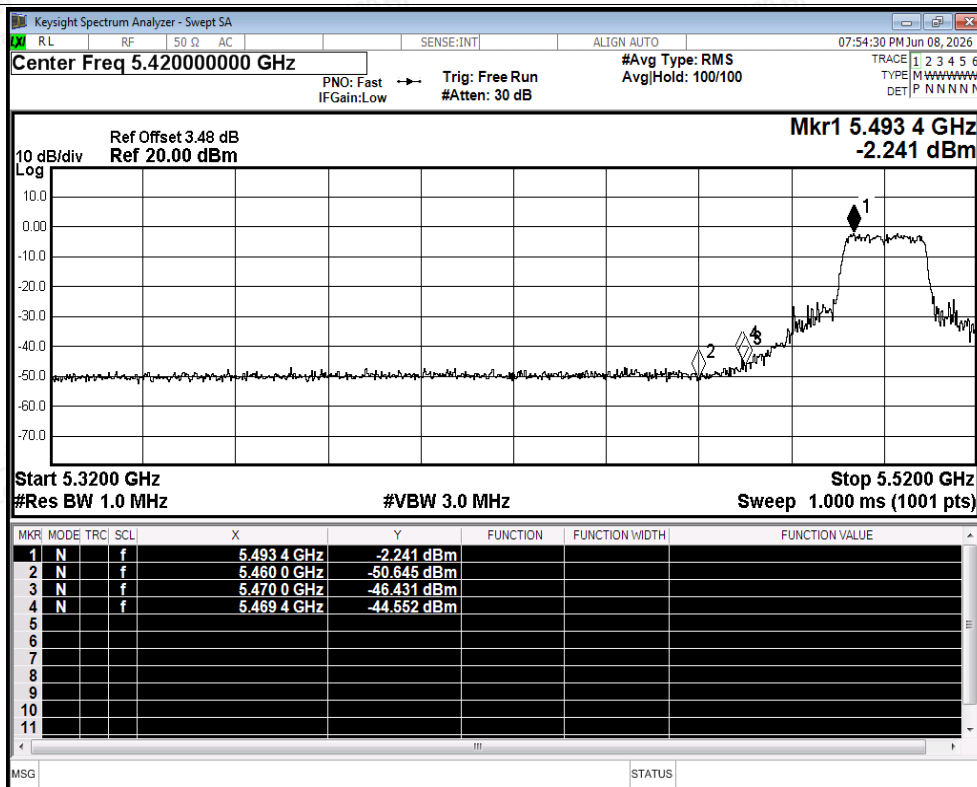

Restrict Band NVNT ax20 5500MHz Ant2 Peak

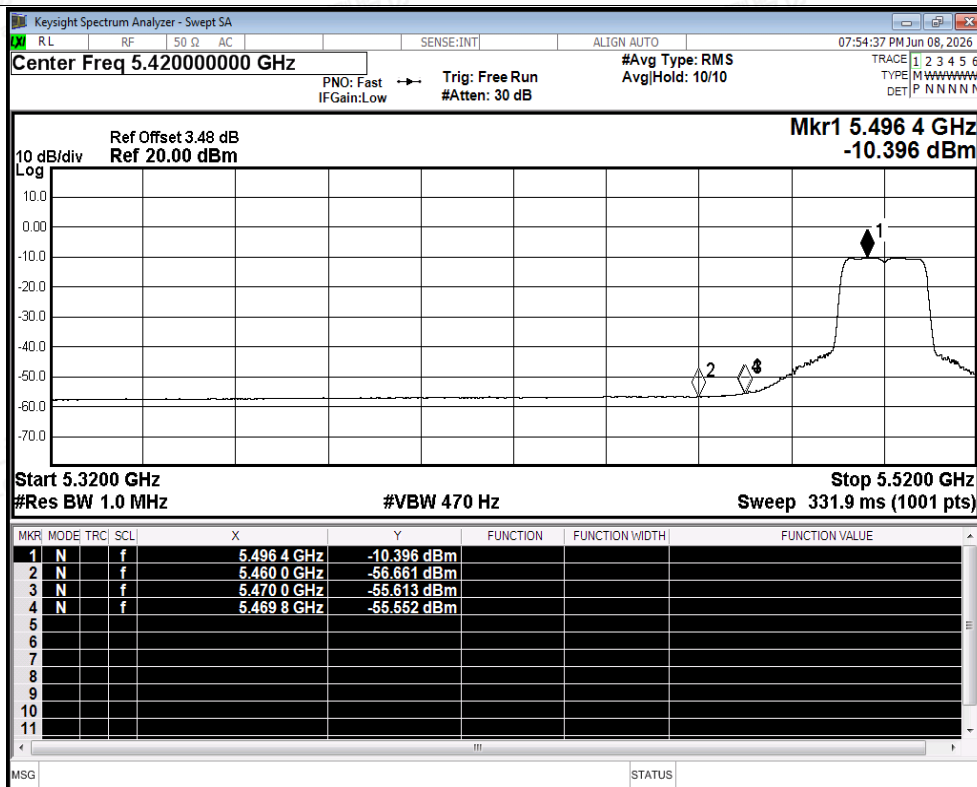

Restrict Band NVNT ax20 5500MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

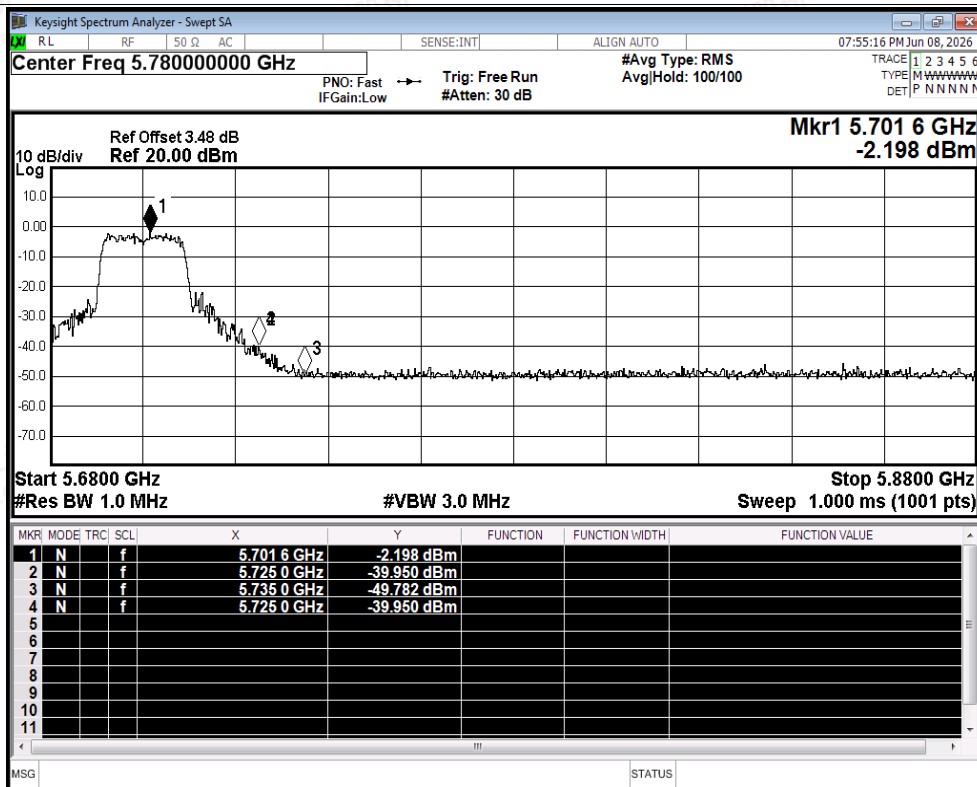

Restrict Band NVNT ax20 5700MHz Ant2 Peak

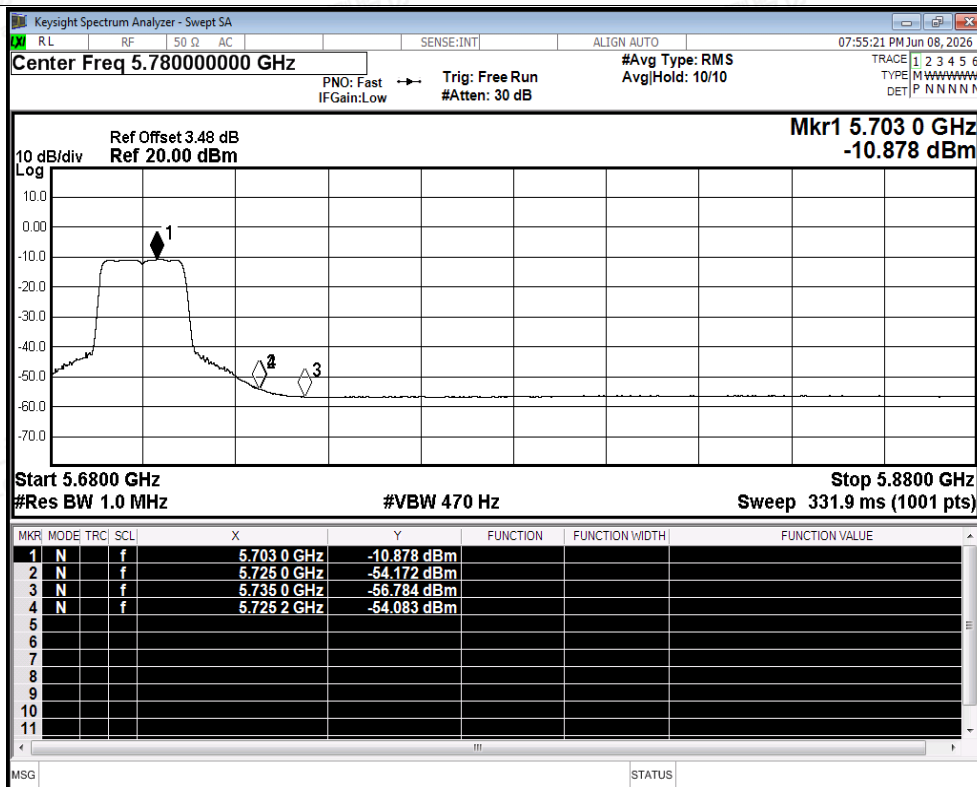

Restrict Band NVNT ax20 5700MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

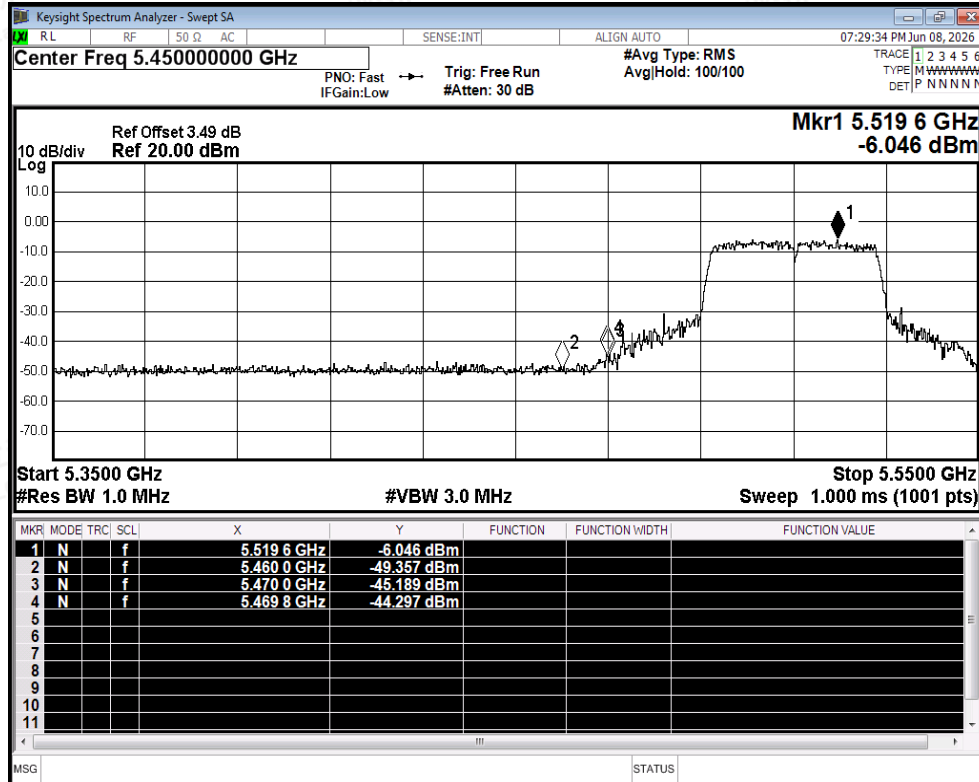

Restrict Band NVNT ax40 5510MHz Ant2 Peak

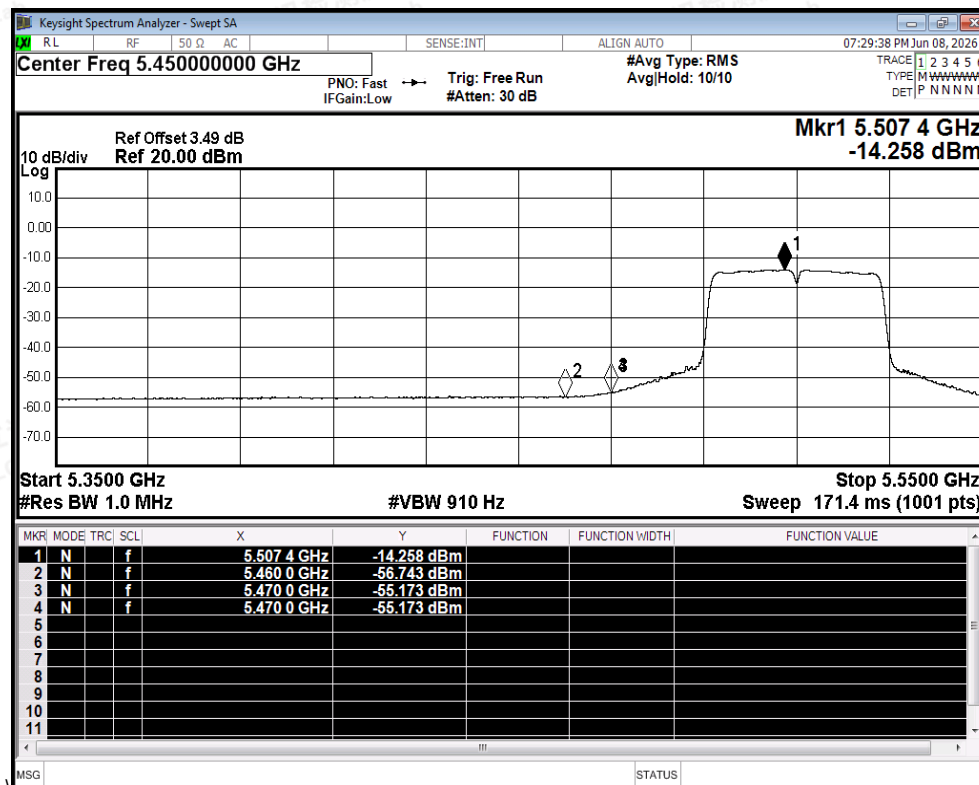

Restrict Band NVNT ax40 5510MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

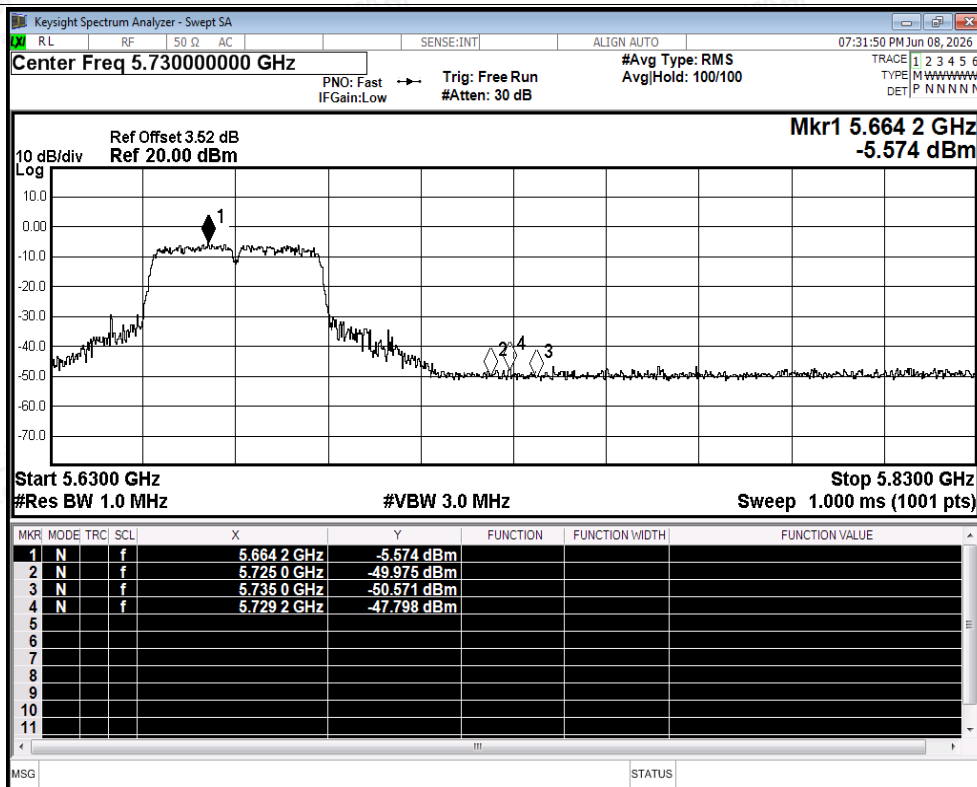

Restrict Band NVNT ax40 5670MHz Ant2 Peak

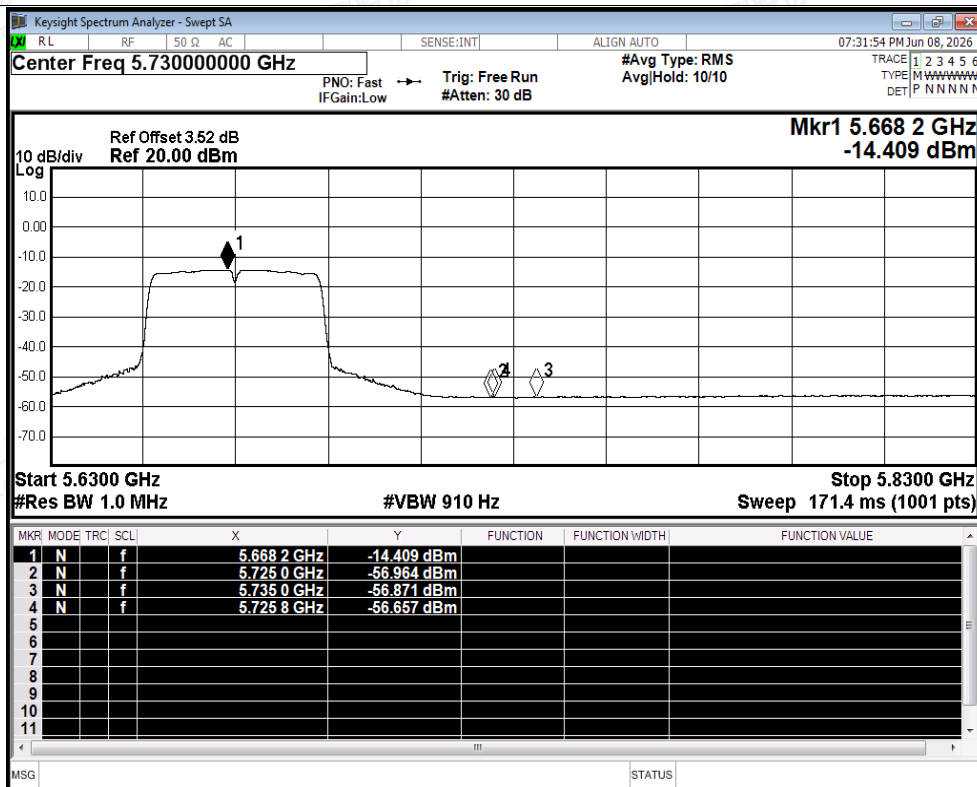

Restrict Band NVNT ax40 5670MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

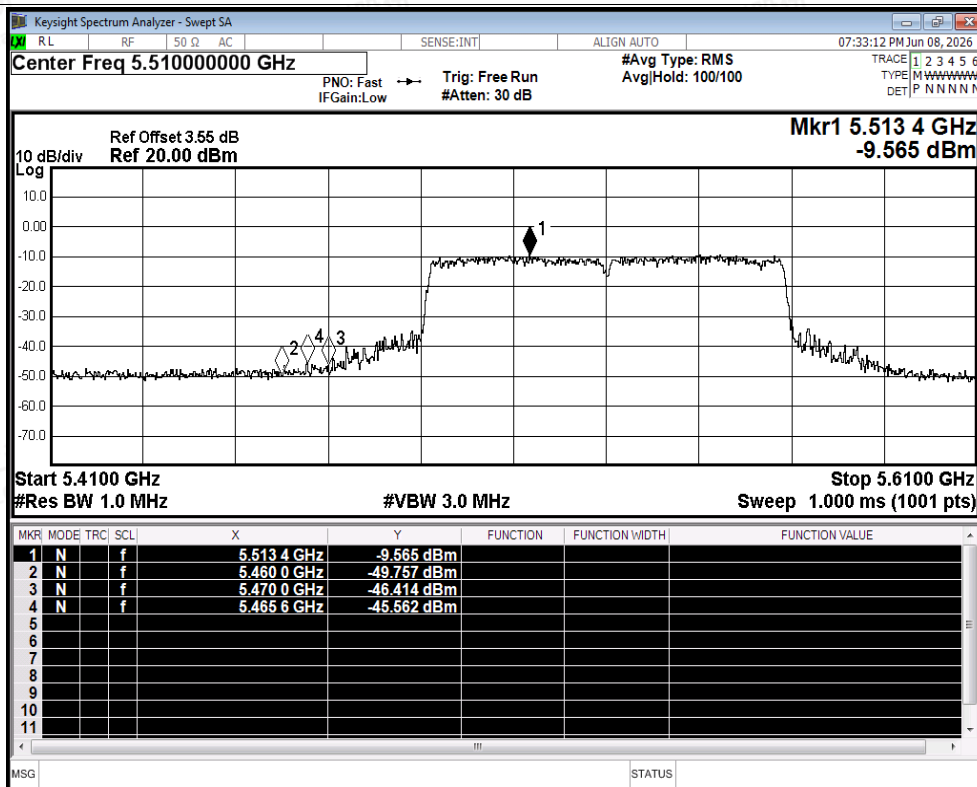

Restrict Band NVNT ax80 5530MHz Ant2 Peak

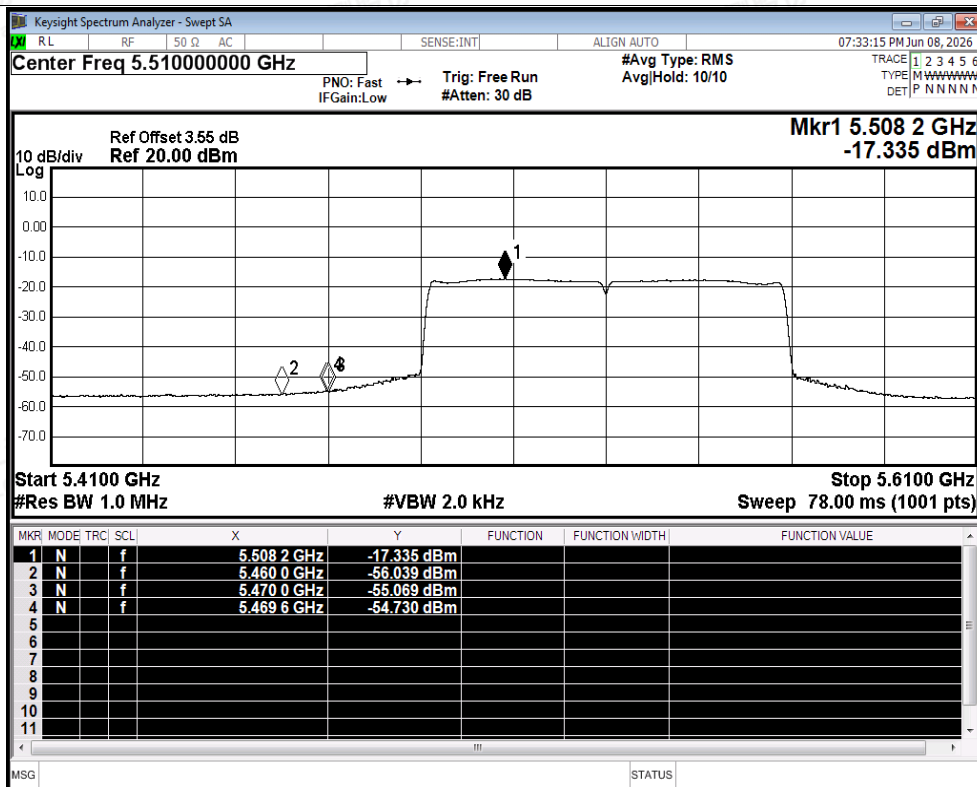

Restrict Band NVNT ax80 5530MHz Ant2 Average




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

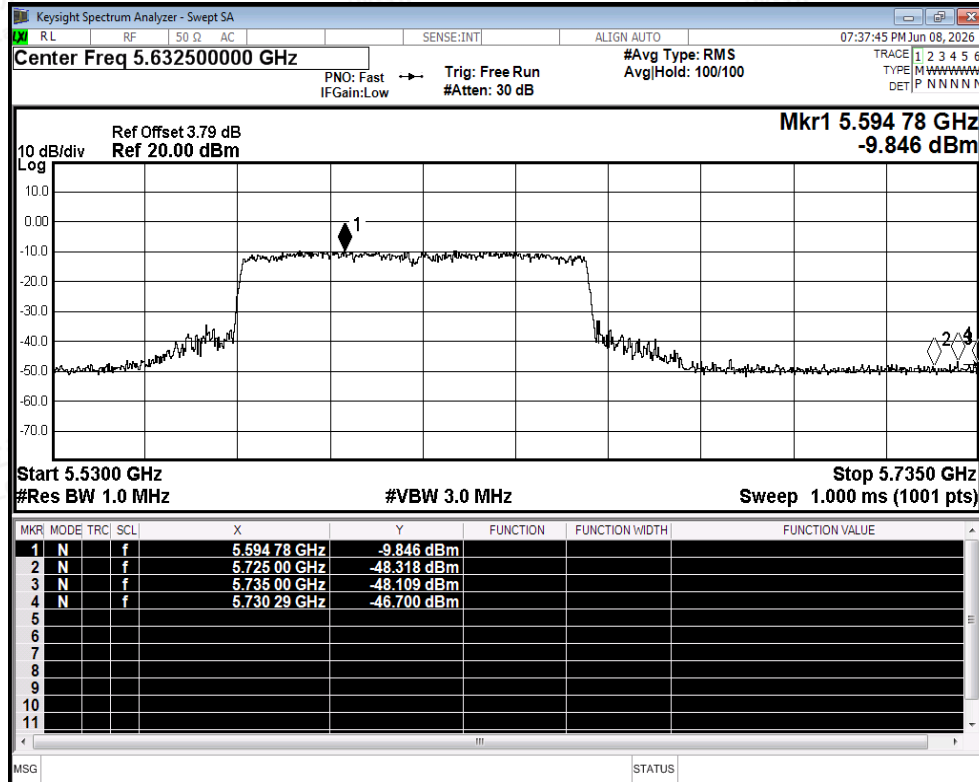

Restrict Band NVNT ax80 5610MHz Ant2 Peak

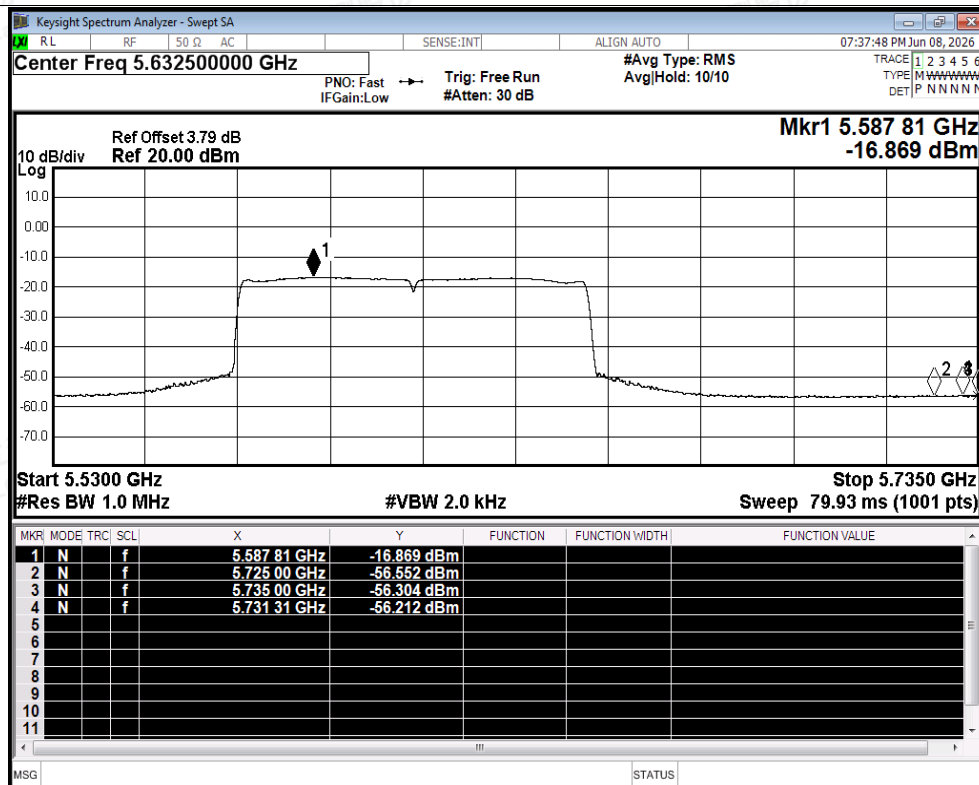

Restrict Band NVNT ax80 5610MHz Ant2 Average



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



MIMO

Condition	Mode	Frequency (MHz)	E (dBuV/m)			Detector	Limit (dBuV/m)	Verdict
			Ant1	Ant2	Ant1+ Ant2			
NVNT	n20	5500	52.3	47.53	56.26	Peak	68.2	Pass
NVNT	n20	5500	44.39	40.5	48.68	Average	54	Pass
NVNT	n20	5500	55.4	50.91	59.46	Peak	68.2	Pass
NVNT	n20	5500	46.08	41.51	50.11	Average	54	Pass
NVNT	n20	5500	55.4	50.08	59.16	Peak	68.2	Pass
NVNT	n20	5500	45.77	41.51	49.92	Average	54	Pass
NVNT	n20	5700	61.26	55.92	65.01	Peak	68.2	Pass
NVNT	n20	5700	47.6	43.17	51.69	Average	54	Pass
NVNT	n20	5700	62.09	55.92	65.56	Peak	68.2	Pass
NVNT	n20	5700	47.6	43.19	51.69	Average	54	Pass
NVNT	n20	5700	50.91	48.49	55.80	Peak	68.2	Pass
NVNT	n20	5700	44.43	40.45	48.69	Average	54	Pass
NVNT	n40	5510	43.54	40.28	48.08	Peak	68.2	Pass
NVNT	n40	5510	36.54	32.93	40.94	Average	54	Pass
NVNT	n40	5510	54.93	52.02	59.62	Peak	68.2	Pass
NVNT	n40	5510	42.14	38.02	46.34	Average	54	Pass
NVNT	n40	5510	54.93	50.2	58.90	Peak	68.2	Pass
NVNT	n40	5510	42.14	38.02	46.34	Average	54	Pass
NVNT	n40	5670	51.27	47.75	55.71	Peak	68.2	Pass
NVNT	n40	5670	44.07	40.35	48.43	Average	54	Pass
NVNT	n40	5670	52.99	48.89	57.20	Peak	68.2	Pass
NVNT	n40	5670	44.32	40.58	48.67	Average	54	Pass
NVNT	n40	5670	50.74	47.32	55.22	Peak	68.2	Pass
NVNT	n40	5670	44.13	40.33	48.46	Average	54	Pass
NVNT	ac20	5500	51.04	47	55.27	Peak	68.2	Pass
NVNT	ac20	5500	44.19	40.38	48.51	Average	54	Pass
NVNT	ac20	5500	60.37	51.13	62.95	Peak	68.2	Pass
NVNT	ac20	5500	45.57	41.59	49.83	Average	54	Pass
NVNT	ac20	5500	50.97	49.44	56.26	Peak	68.2	Pass
NVNT	ac20	5500	45.57	41.59	49.83	Average	54	Pass
NVNT	ac20	5700	59.63	57.49	64.65	Peak	68.2	Pass
NVNT	ac20	5700	47.03	43.39	51.42	Average	54	Pass
NVNT	ac20	5700	59.63	57.49	64.65	Peak	68.2	Pass
NVNT	ac20	5700	47.03	43.39	51.42	Average	54	Pass
NVNT	ac20	5700	51.09	47.81	55.62	Peak	68.2	Pass
NVNT	ac20	5700	44.21	40.47	48.56	Average	54	Pass
NVNT	ac40	5510	43.37	40.9	48.24	Peak	68.2	Pass
NVNT	ac40	5510	36.56	32.74	40.88	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac40	5510	55.27	53.28	60.35	Peak	68.2	Pass
NVNT	ac40	5510	42.22	38.13	46.43	Average	54	Pass
NVNT	ac40	5510	53.36	52.06	58.75	Peak	68.2	Pass
NVNT	ac40	5510	42.22	38.13	46.43	Average	54	Pass
NVNT	ac40	5670	49.99	45.93	54.22	Peak	68.2	Pass
NVNT	ac40	5670	44.26	40.3	48.52	Average	54	Pass
NVNT	ac40	5670	53.27	50.13	57.86	Peak	68.2	Pass
NVNT	ac40	5670	44.3	40.56	48.65	Average	54	Pass
NVNT	ac40	5670	53.27	48.67	57.29	Peak	68.2	Pass
NVNT	ac40	5670	44.12	40.27	48.43	Average	54	Pass
NVNT	ac80	5530	51.65	47.38	55.80	Peak	68.2	Pass
NVNT	ac80	5530	45.32	40.91	49.41	Average	54	Pass
NVNT	ac80	5530	55.59	53.17	60.48	Peak	68.2	Pass
NVNT	ac80	5530	46.17	42.28	50.46	Average	54	Pass
NVNT	ac80	5530	52.08	50.42	57.31	Peak	68.2	Pass
NVNT	ac80	5530	46.08	42.08	50.33	Average	54	Pass
NVNT	ac80	5610	51.5	48.51	56.15	Peak	68.2	Pass
NVNT	ac80	5610	44.37	40.92	48.84	Average	54	Pass
NVNT	ac80	5610	52.67	51.02	57.90	Peak	68.2	Pass
NVNT	ac80	5610	44.96	41.1	49.26	Average	54	Pass
NVNT	ac80	5610	52.67	51.02	57.90	Peak	68.2	Pass
NVNT	ac80	5610	44.93	40.99	49.20	Average	54	Pass
NVNT	ax20	5500	51.53	46.62	55.44	Peak	68.2	Pass
NVNT	ax20	5500	44.29	40.6	48.66	Average	54	Pass
NVNT	ax20	5500	56.44	52.71	60.79	Peak	68.2	Pass
NVNT	ax20	5500	45.48	41.71	49.82	Average	54	Pass
NVNT	ax20	5500	55.63	50.83	59.58	Peak	68.2	Pass
NVNT	ax20	5500	45.48	41.65	49.80	Average	54	Pass
NVNT	ax20	5700	58.14	57.32	63.76	Peak	68.2	Pass
NVNT	ax20	5700	46.94	43.09	51.25	Average	54	Pass
NVNT	ax20	5700	60.1	57.32	64.84	Peak	68.2	Pass
NVNT	ax20	5700	47.05	43.18	51.35	Average	54	Pass
NVNT	ax20	5700	50.98	47.48	55.43	Peak	68.2	Pass
NVNT	ax20	5700	44.19	40.48	48.55	Average	54	Pass
NVNT	ax40	5510	51.85	47.91	56.12	Peak	68.2	Pass
NVNT	ax40	5510	44.31	40.52	48.64	Average	54	Pass
NVNT	ax40	5510	56.84	52.97	61.14	Peak	68.2	Pass
NVNT	ax40	5510	45.75	42.09	50.13	Average	54	Pass
NVNT	ax40	5510	52.7	52.08	58.42	Peak	68.2	Pass
NVNT	ax40	5510	45.7	42.09	50.10	Average	54	Pass
NVNT	ax40	5670	50.52	47.29	55.07	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax40	5670	44.14	40.3	48.45	Average	54	Pass
NVNT	ax40	5670	53.74	49.47	57.89	Peak	68.2	Pass
NVNT	ax40	5670	44.47	40.61	48.77	Average	54	Pass
NVNT	ax40	5670	51	46.69	55.13	Peak	68.2	Pass
NVNT	ax40	5670	44.11	40.39	48.47	Average	54	Pass
NVNT	ax80	5530	52.45	47.51	56.35	Peak	68.2	Pass
NVNT	ax80	5530	45.12	41.23	49.41	Average	54	Pass
NVNT	ax80	5530	54.79	51.7	59.40	Peak	68.2	Pass
NVNT	ax80	5530	46.05	42.53	50.49	Average	54	Pass
NVNT	ax80	5530	53.08	50.85	58.06	Peak	68.2	Pass
NVNT	ax80	5530	46.03	42.2	50.35	Average	54	Pass
NVNT	ax80	5610	51.14	46.98	55.33	Peak	68.2	Pass
NVNT	ax80	5610	44.8	40.68	49.00	Average	54	Pass
NVNT	ax80	5610	52.83	50.57	57.79	Peak	68.2	Pass
NVNT	ax80	5610	44.92	41.05	49.22	Average	54	Pass
NVNT	ax80	5610	52.83	49.16	57.21	Peak	68.2	Pass
NVNT	ax80	5610	44.92	40.96	49.18	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity




F.5 Frequency Stability

Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5500	Ant1	5499.98	-20000	-3.64	25	Pass
NVNT	a	5580	Ant1	5580	0	0	25	Pass
NVNT	a	5700	Ant1	5699.98	-20000	-3.51	25	Pass
NVNT	n20	5500	Ant1	5500	0	0	25	Pass
NVNT	n20	5580	Ant1	5579.96	-40000	-7.17	25	Pass
NVNT	n20	5700	Ant1	5699.98	-20000	-3.51	25	Pass
NVNT	n40	5510	Ant1	5510	0	0	25	Pass
NVNT	n40	5550	Ant1	5550	0	0	25	Pass
NVNT	n40	5670	Ant1	5670	0	0	25	Pass
NVNT	ac20	5500	Ant1	5499.98	-20000	-3.64	25	Pass
NVNT	ac20	5580	Ant1	5580	0	0	25	Pass
NVNT	ac20	5700	Ant1	5700	0	0	25	Pass
NVNT	ac40	5510	Ant1	5509.96	-40000	-7.26	25	Pass
NVNT	ac40	5550	Ant1	5550	0	0	25	Pass
NVNT	ac40	5670	Ant1	5670	0	0	25	Pass
NVNT	ac80	5530	Ant1	5530	0	0	25	Pass
NVNT	ac80	5610	Ant1	5610	0	0	25	Pass
NVNT	ax20	5500	Ant1	5499.96	-40000	-7.27	25	Pass
NVNT	ax20	5580	Ant1	5579.96	-40000	-7.17	25	Pass
NVNT	ax20	5700	Ant1	5699.98	-20000	-3.51	25	Pass
NVNT	ax40	5510	Ant1	5509.96	-40000	-7.26	25	Pass
NVNT	ax40	5550	Ant1	5550	0	0	25	Pass
NVNT	ax40	5670	Ant1	5670	0	0	25	Pass
NVNT	ax80	5530	Ant1	5530	0	0	25	Pass
NVNT	ax80	5610	Ant1	5610	0	0	25	Pass



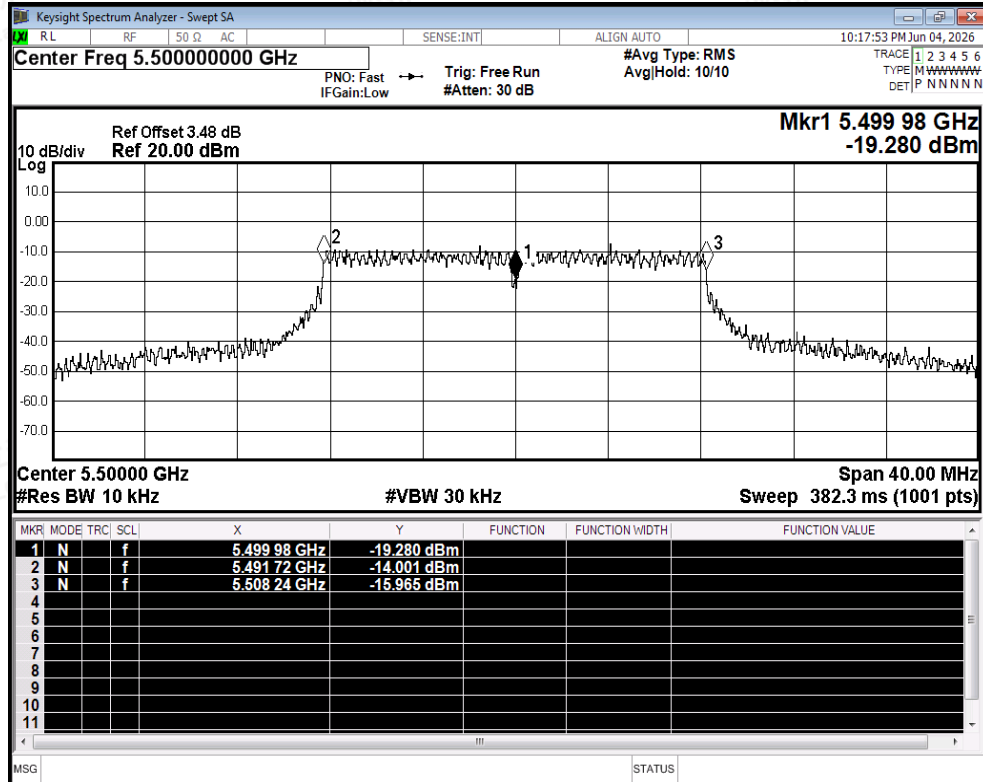

Freq. Stability NVNT a 5500MHz Ant1

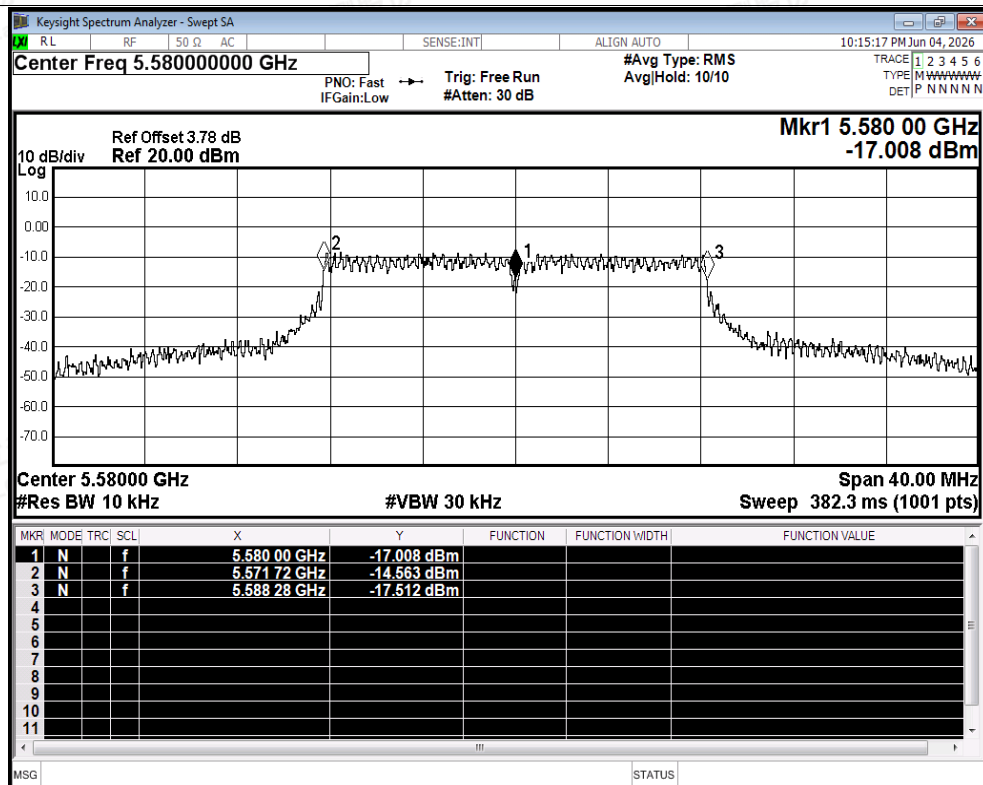

Freq. Stability NVNT a 5580MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

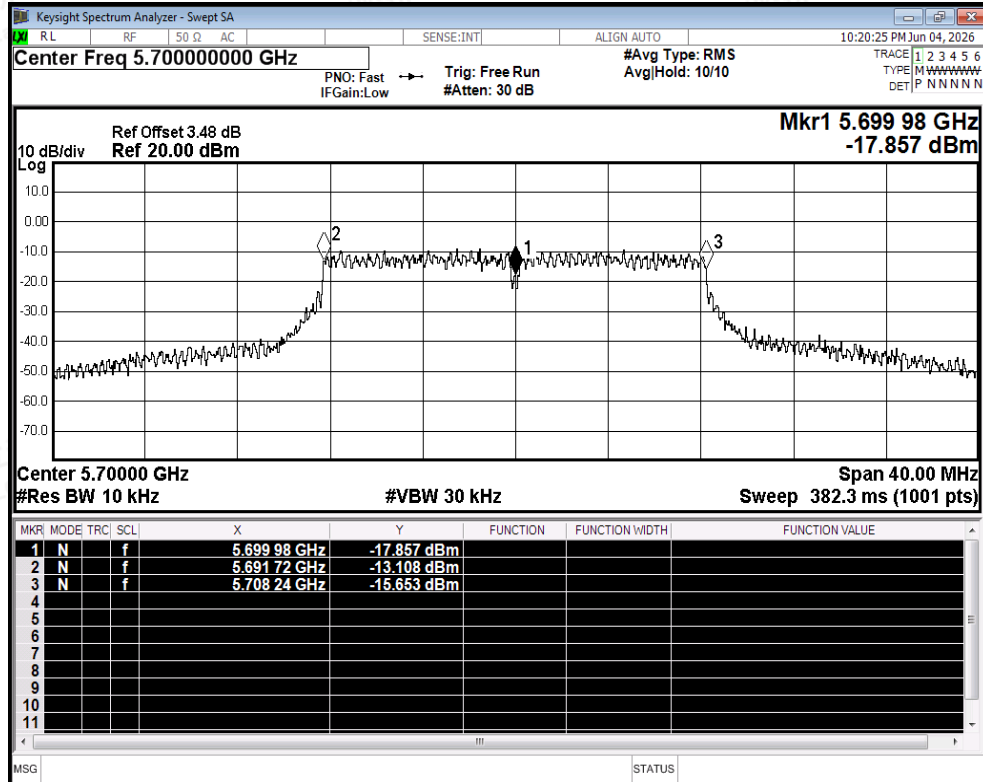

Freq. Stability NVNT a 5700MHz Ant1

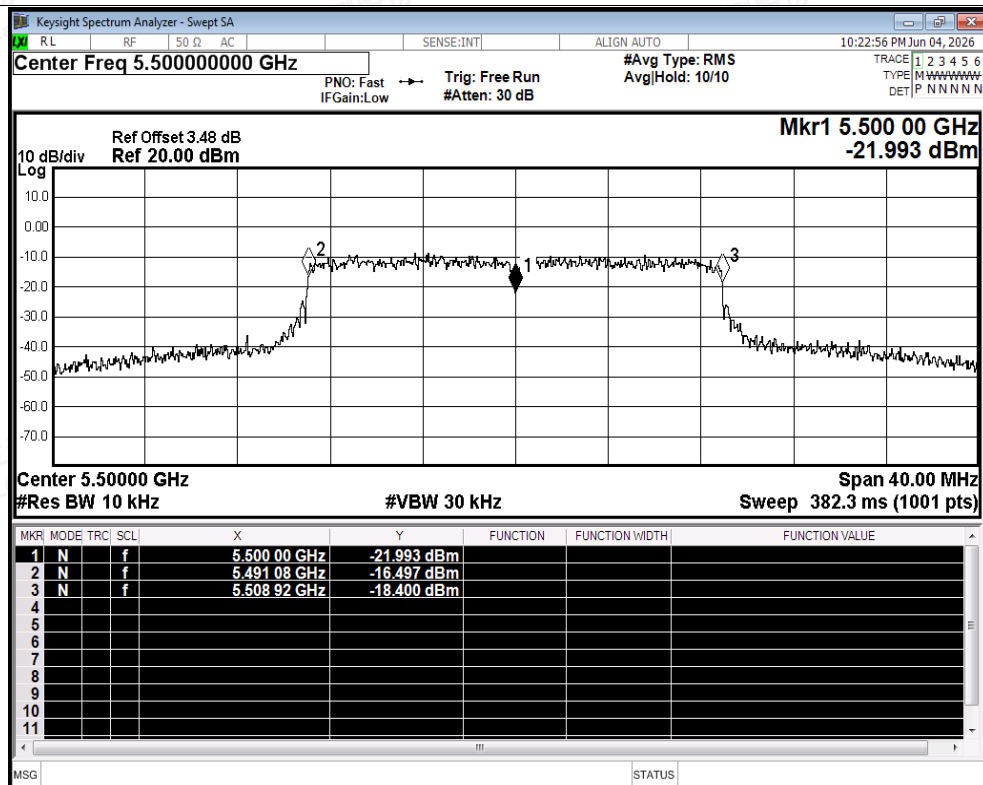

Freq. Stability NVNT n20 5500MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

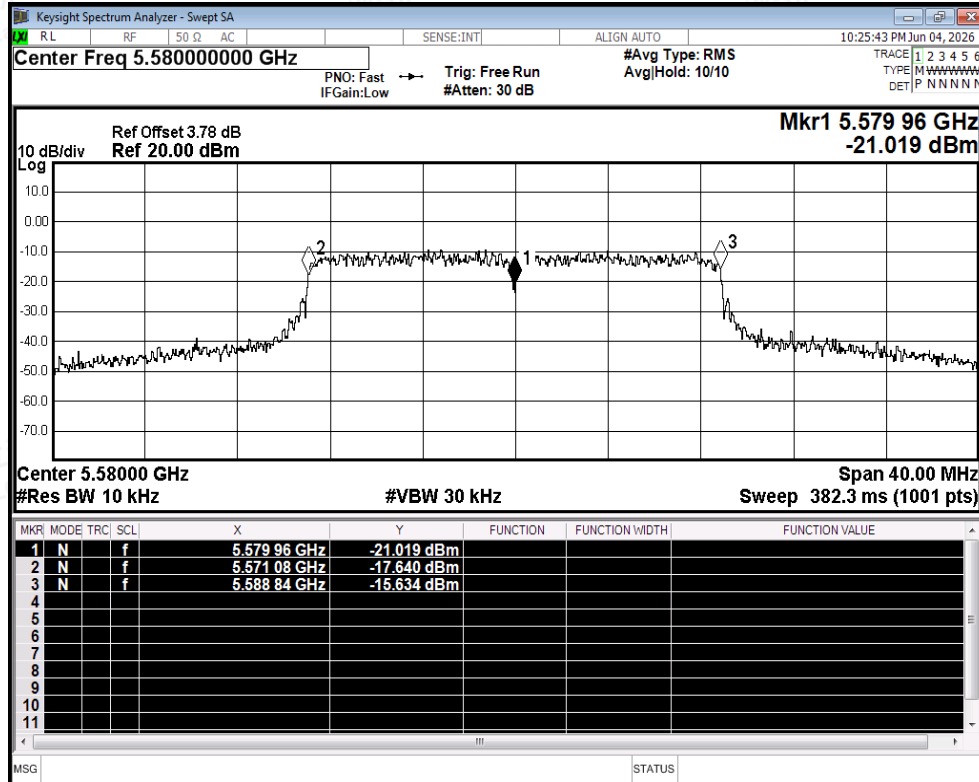

Freq. Stability NVNT n20 5580MHz Ant1

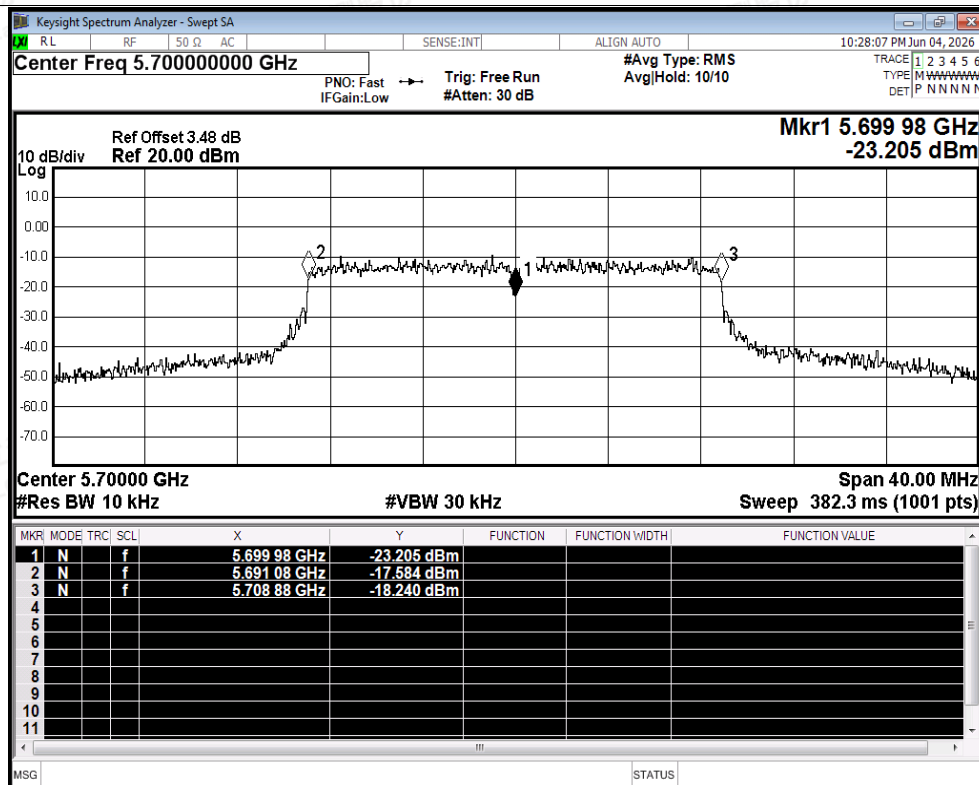

Freq. Stability NVNT n20 5700MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

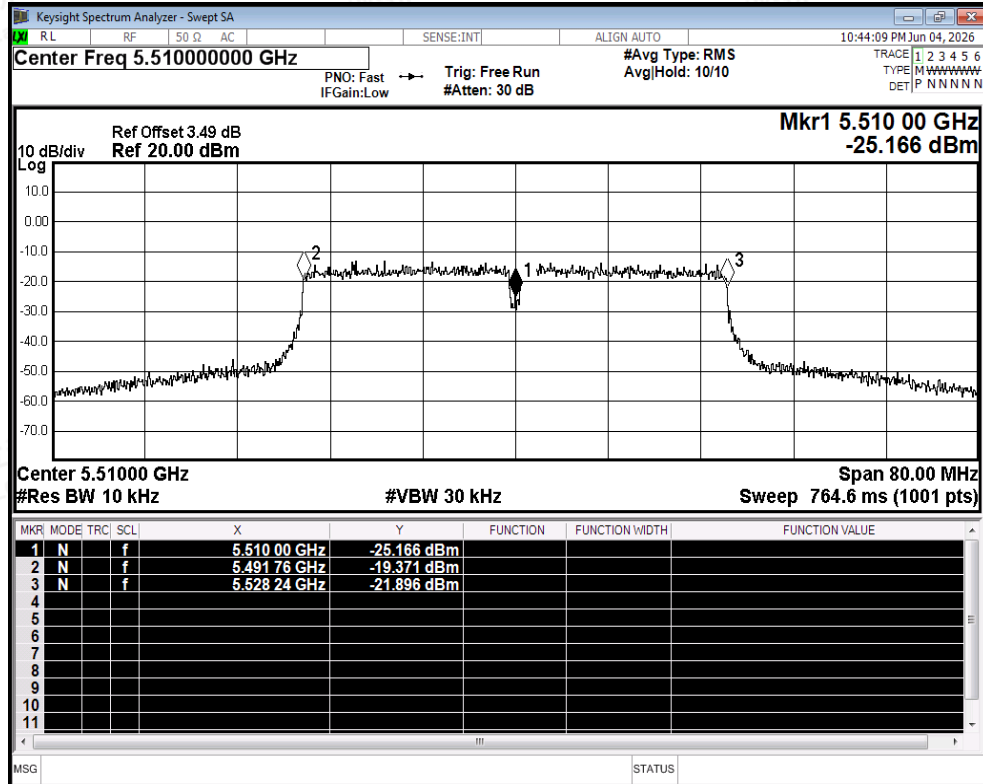

Freq. Stability NVNT n40 5510MHz Ant1

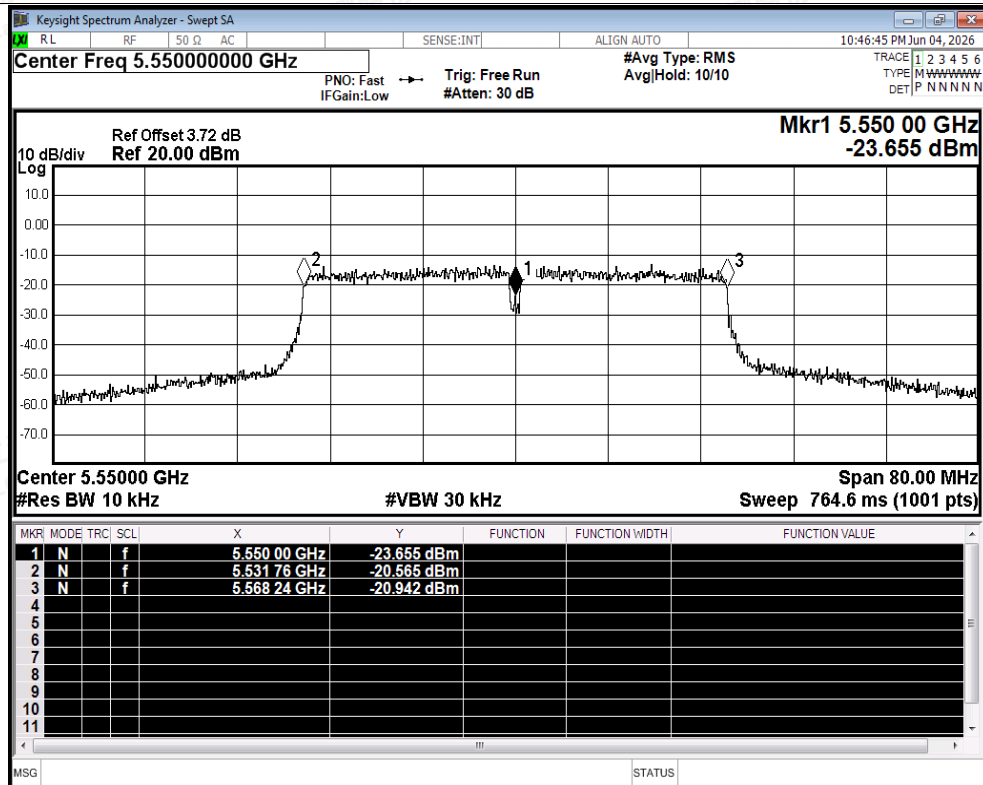

Freq. Stability NVNT n40 5550MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

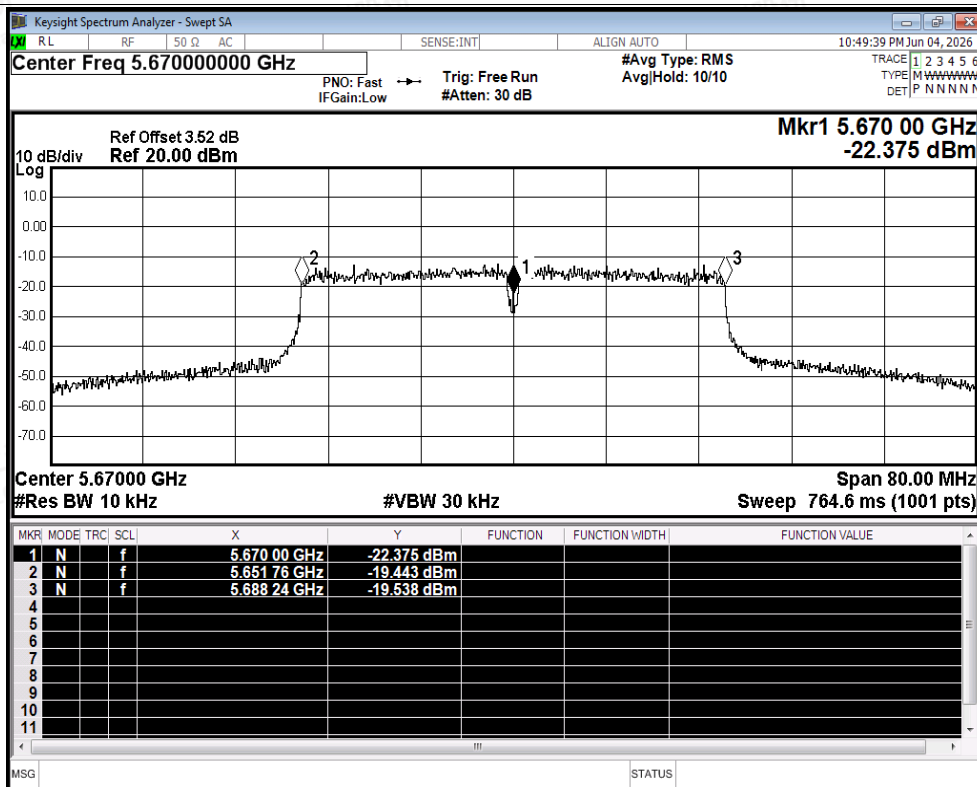

Freq. Stability NVNT n40 5670MHz Ant1

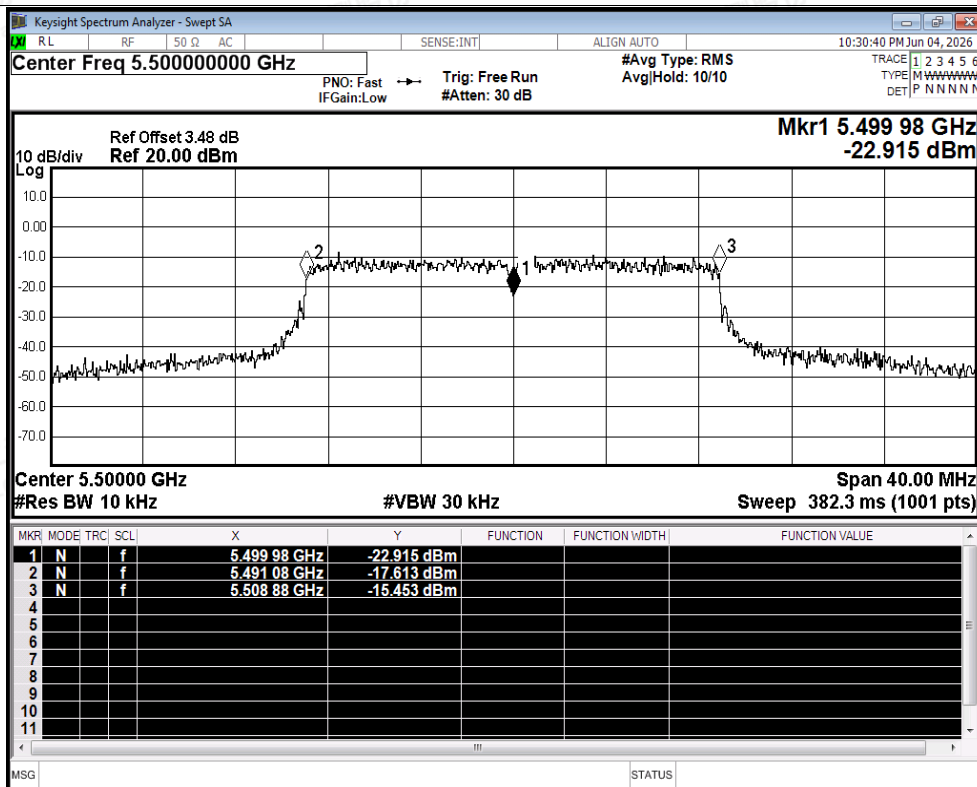

Freq. Stability NVNT ac20 5500MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

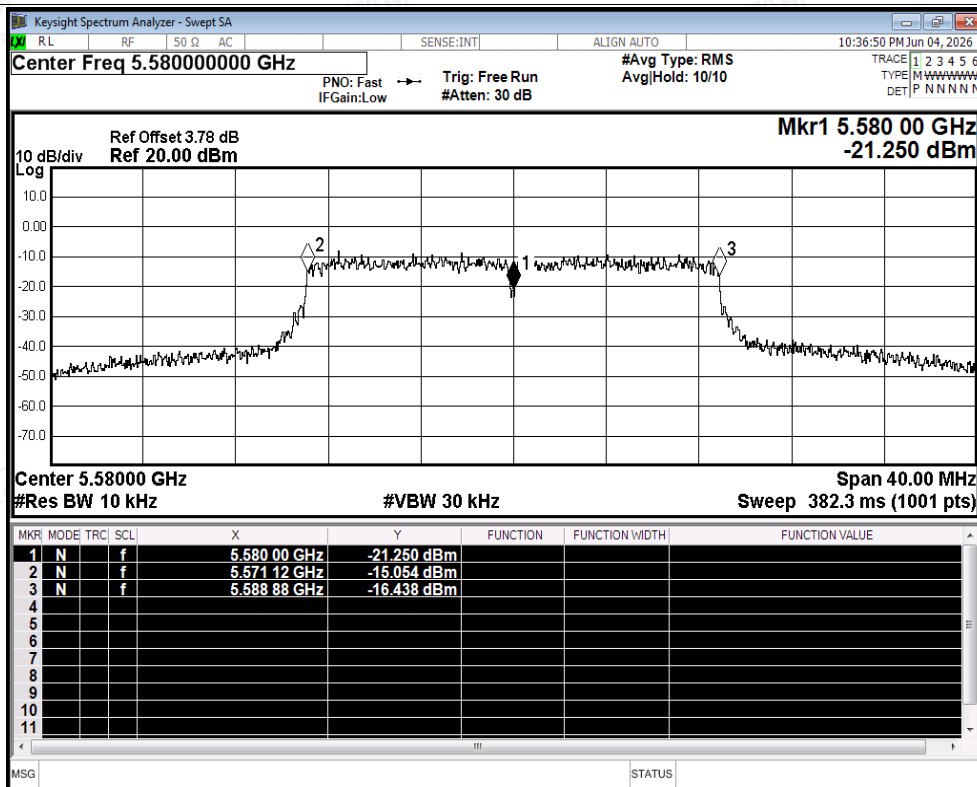

Freq. Stability NVNT ac20 5580MHz Ant1

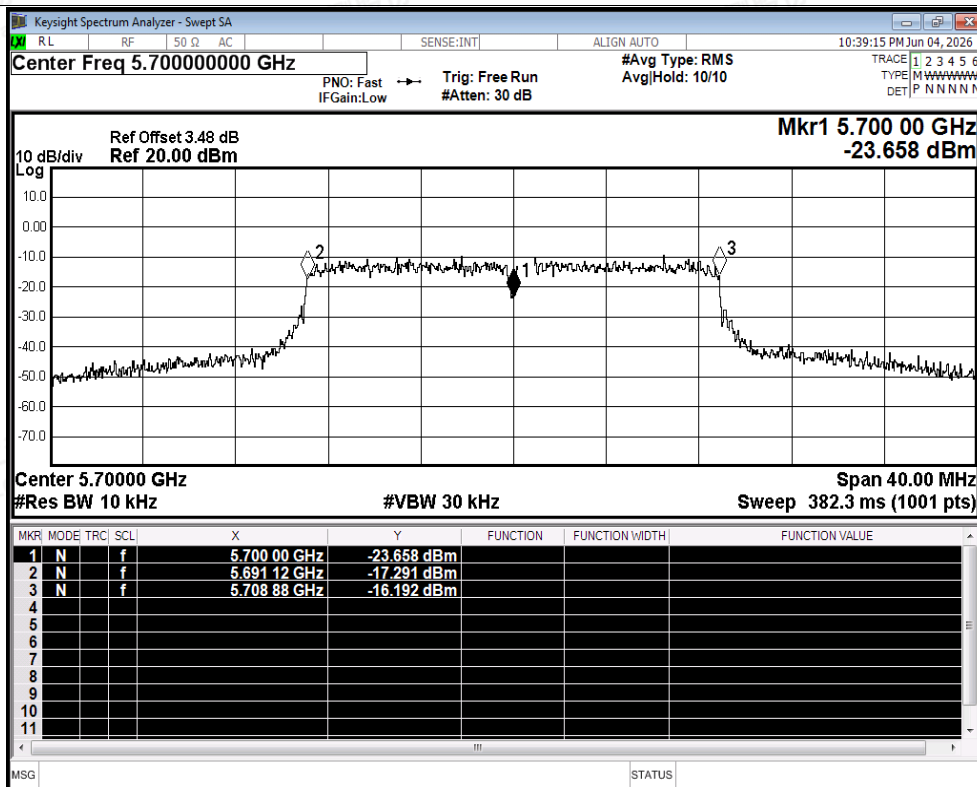

Freq. Stability NVNT ac20 5700MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

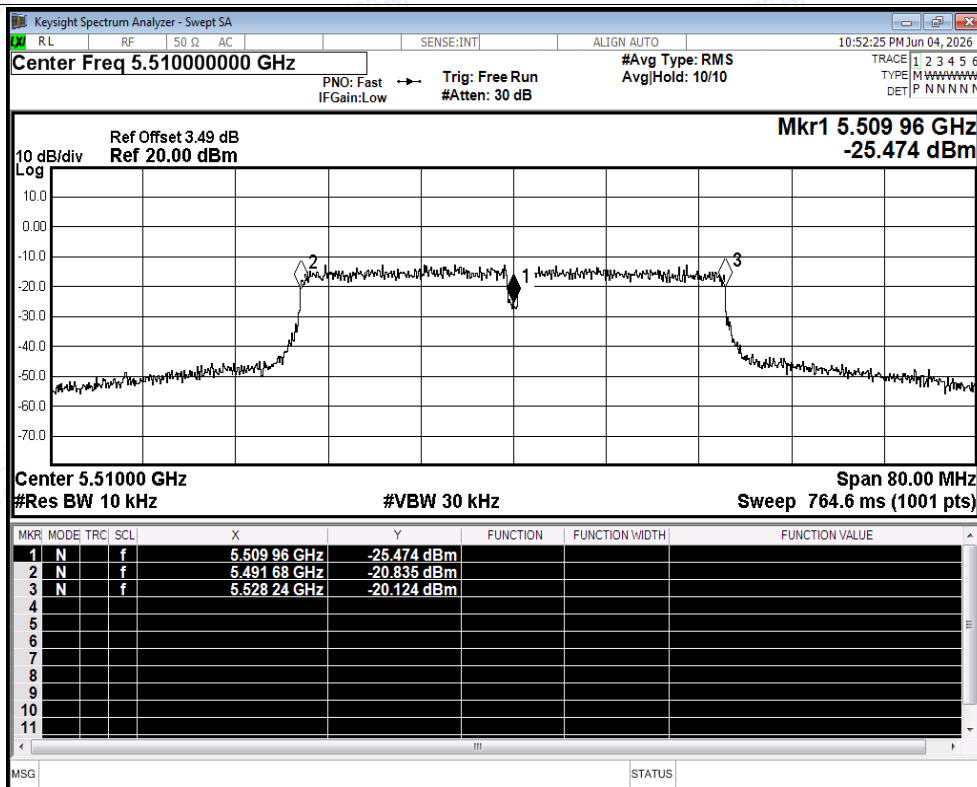

Freq. Stability NVNT ac40 5510MHz Ant1

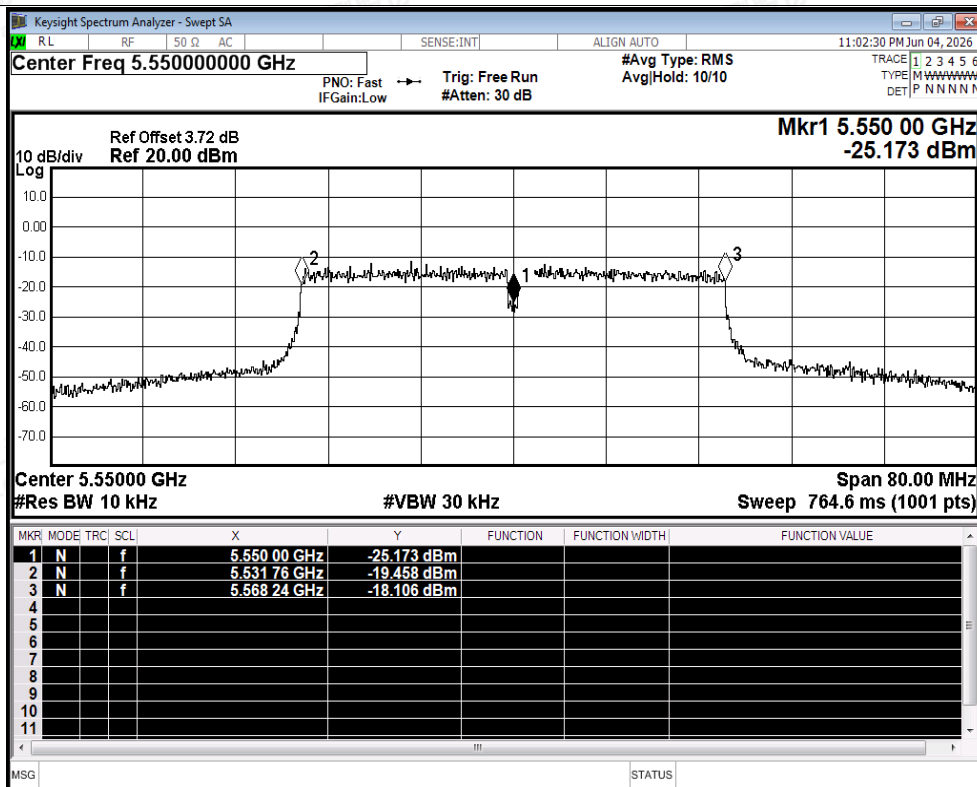

Freq. Stability NVNT ac40 5550MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

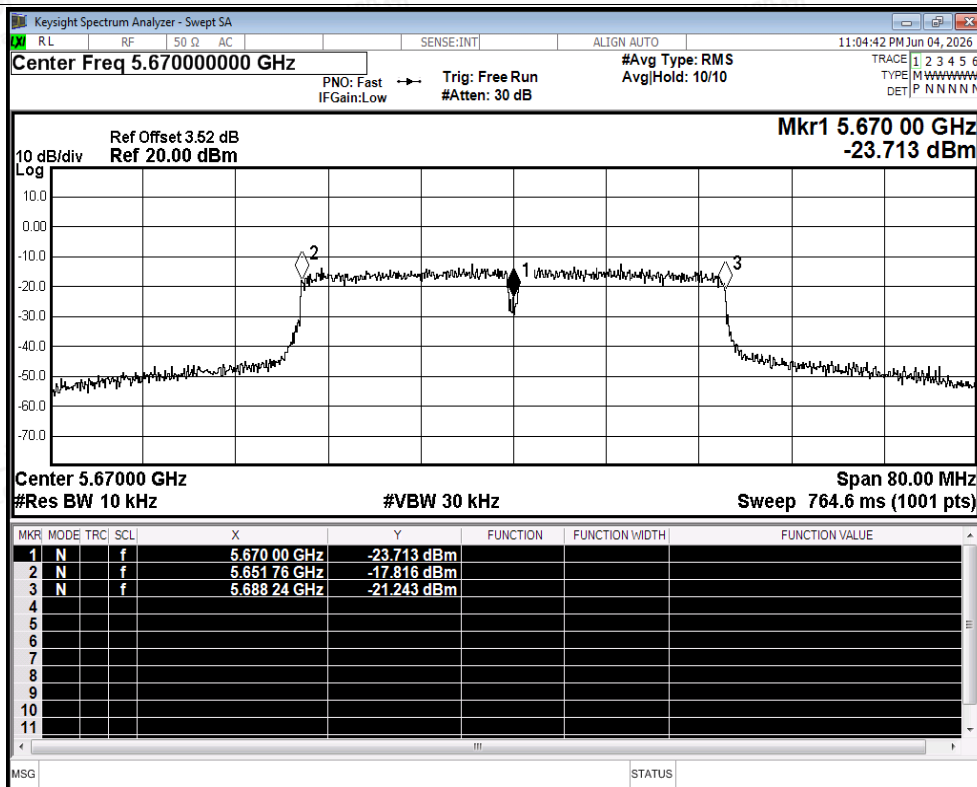

Freq. Stability NVNT ac40 5670MHz Ant1

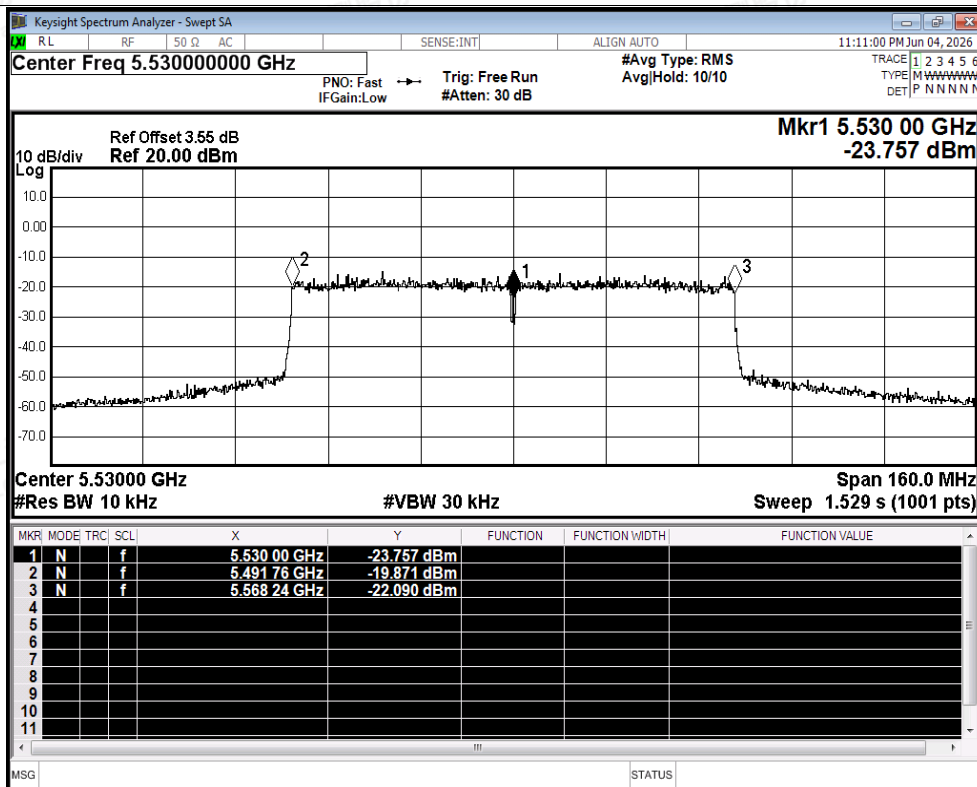

Freq. Stability NVNT ac80 5530MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

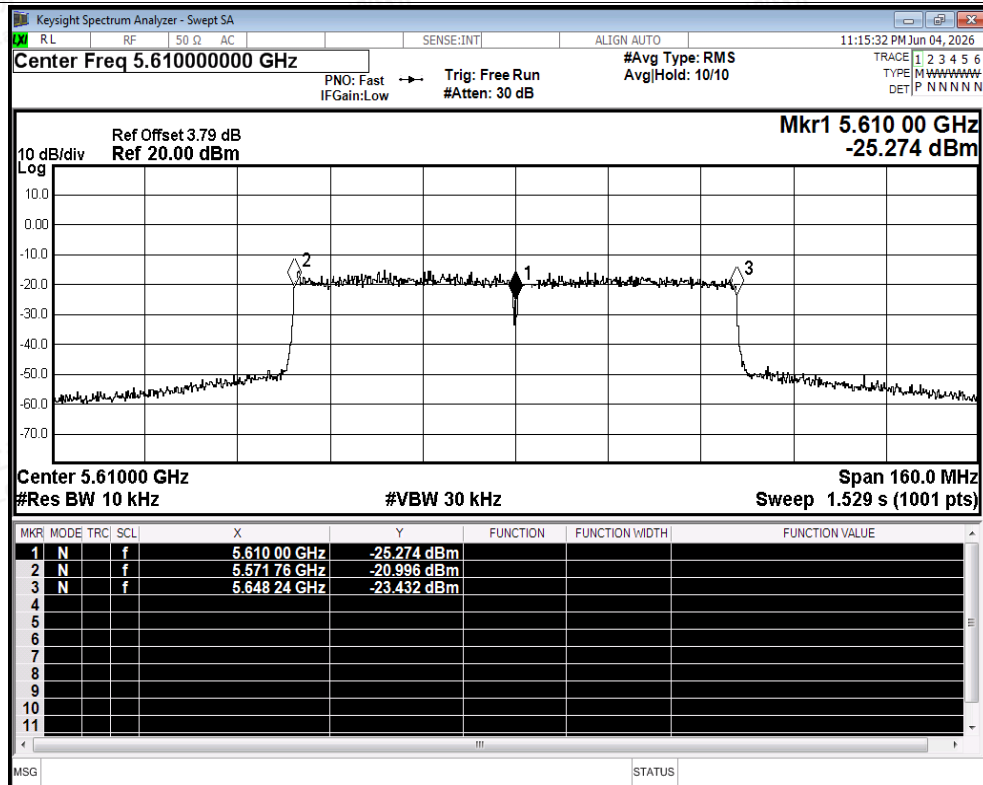

Freq. Stability NVNT ac80 5610MHz Ant1

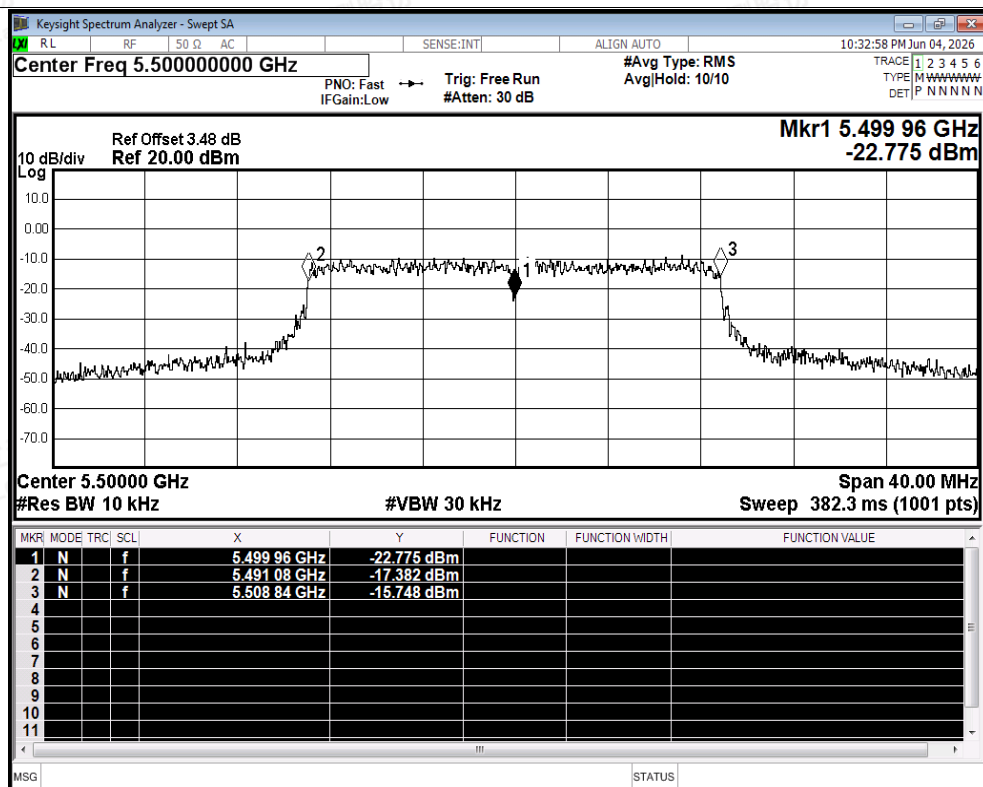

Freq. Stability NVNT ax20 5500MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

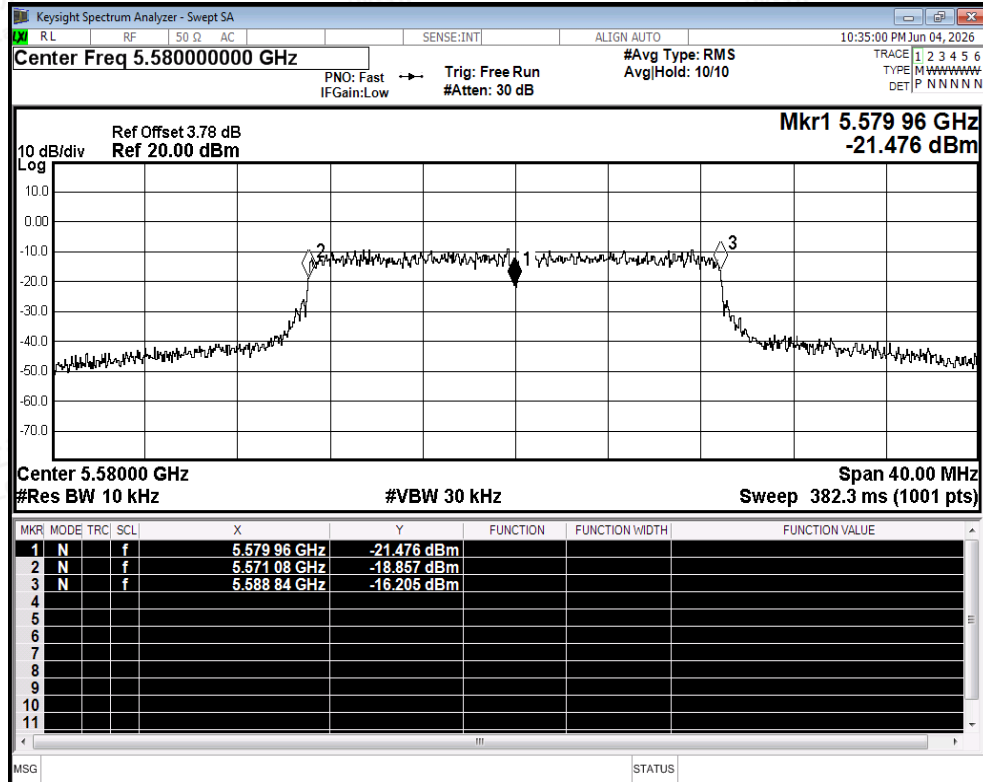

Freq. Stability NVNT ax20 5580MHz Ant1

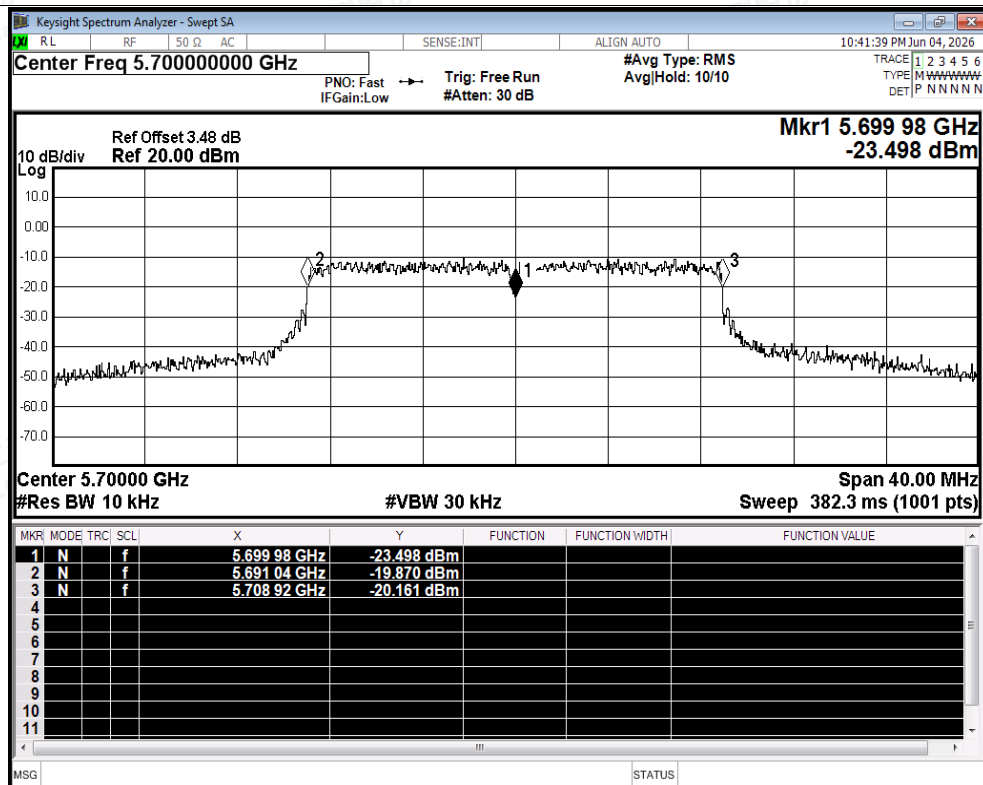

Freq. Stability NVNT ax20 5700MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

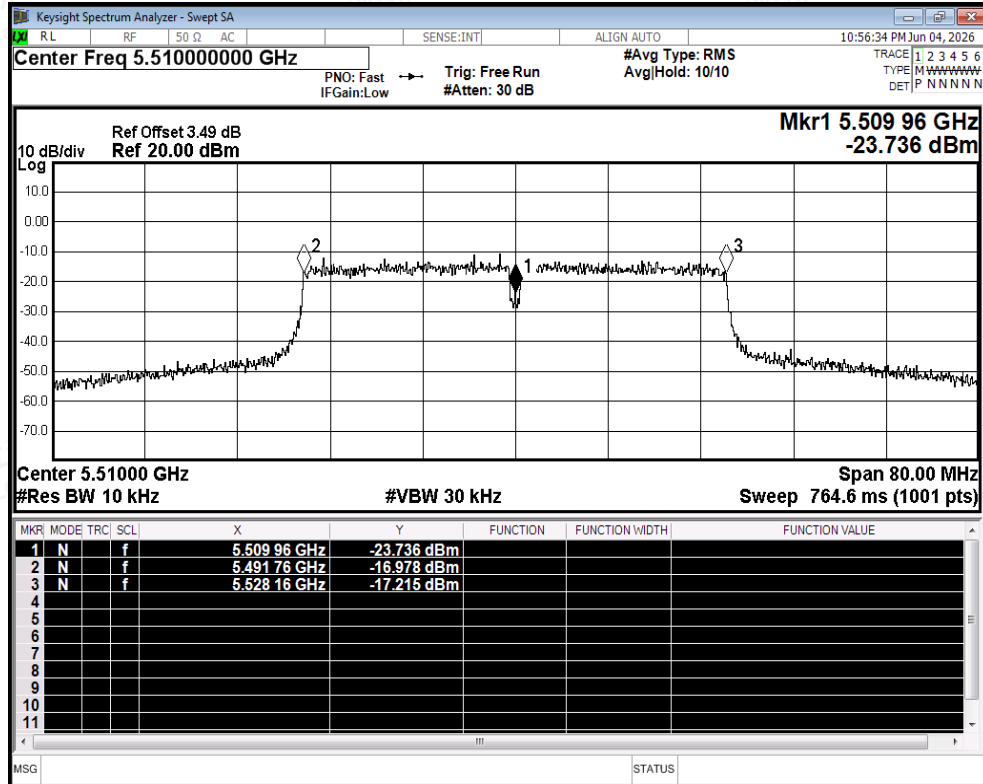

Freq. Stability NVNT ax40 5510MHz Ant1

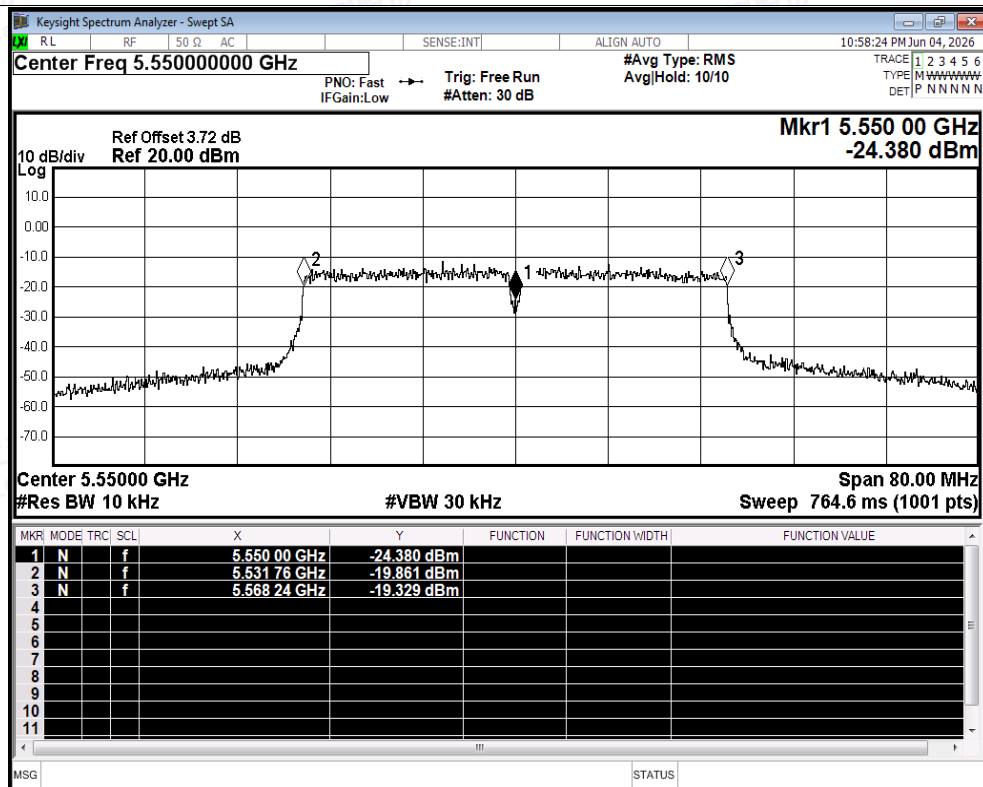

Freq. Stability NVNT ax40 5550MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

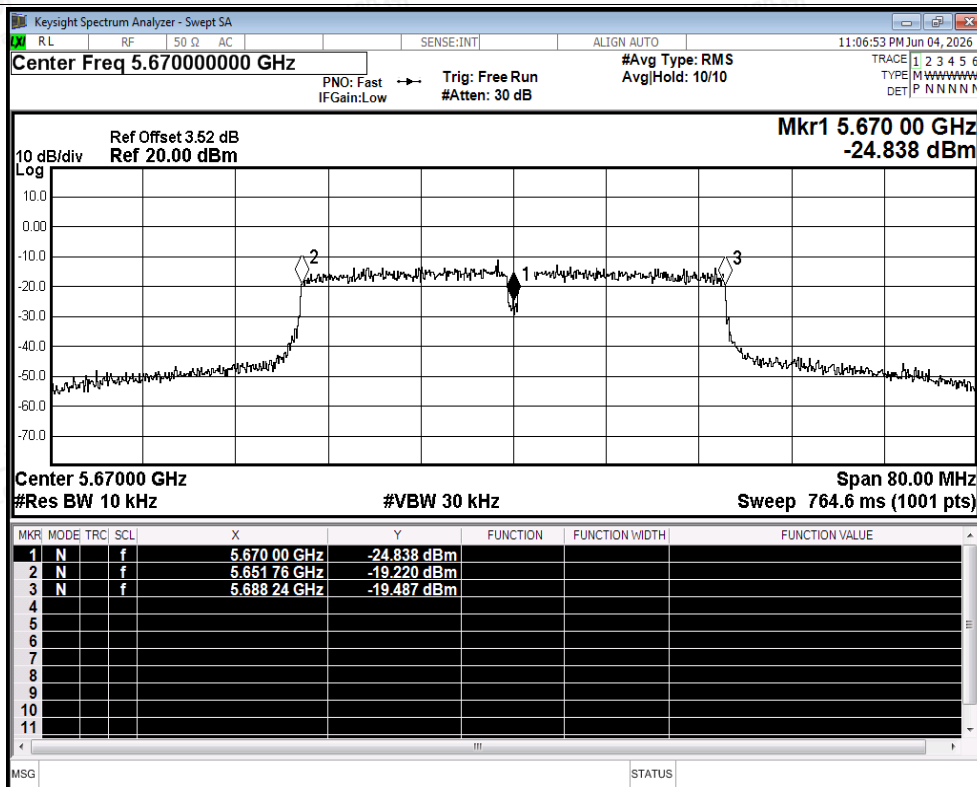

Freq. Stability NVNT ax40 5670MHz Ant1

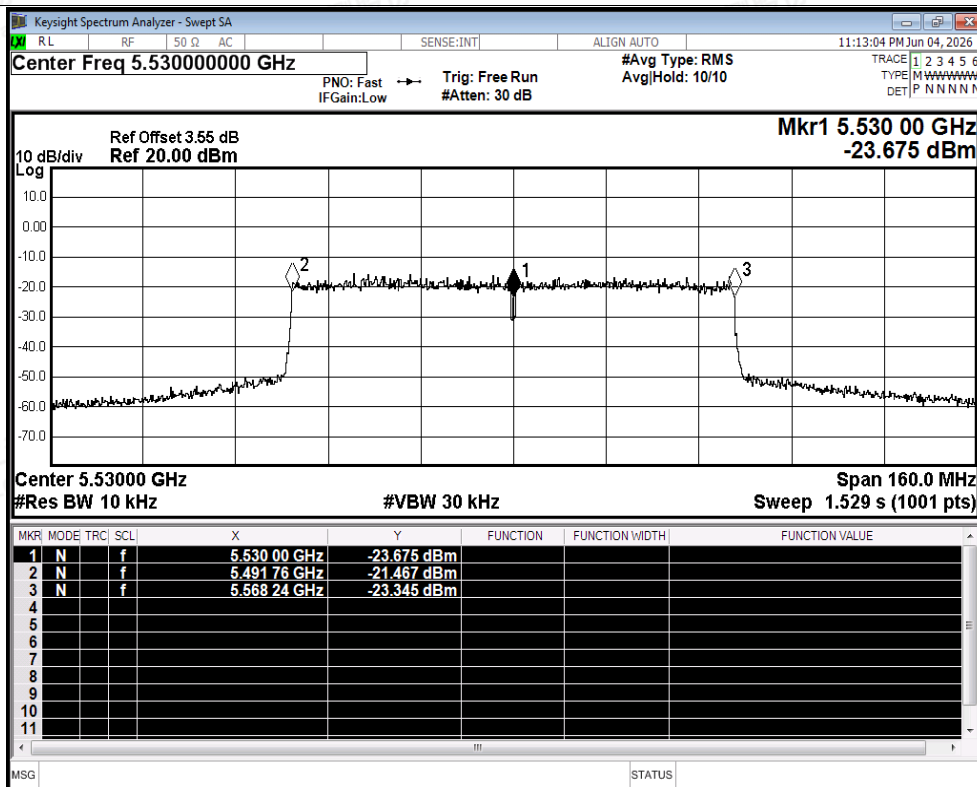

Freq. Stability NVNT ax80 5530MHz Ant1




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

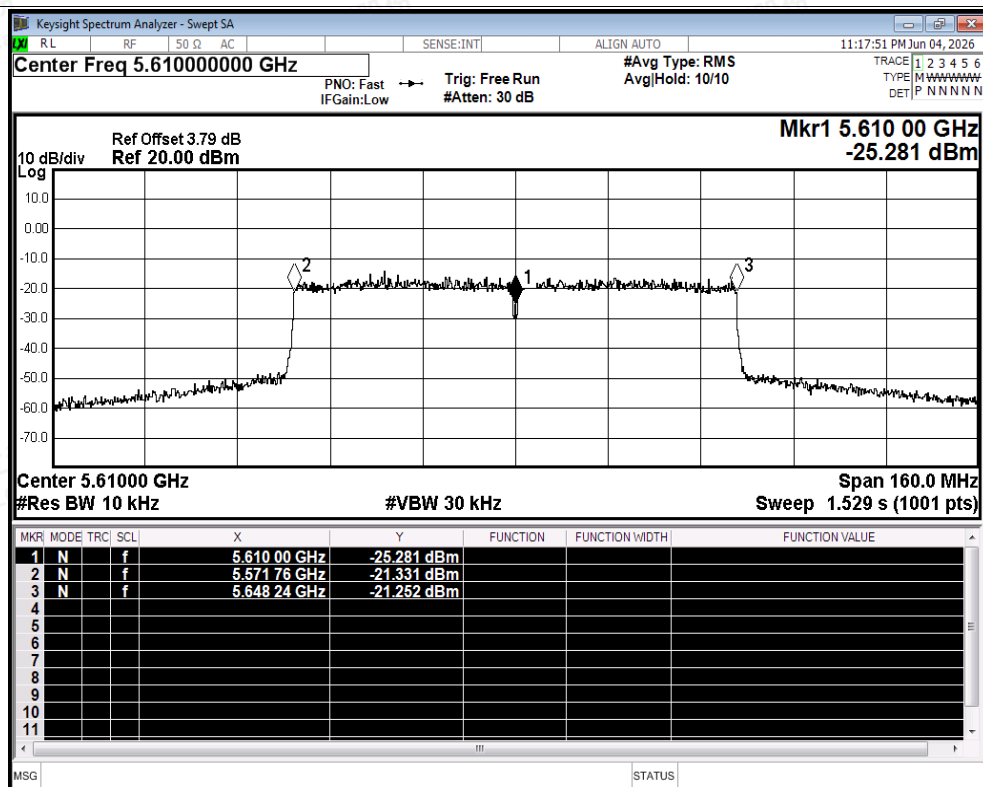

Freq. Stability NVNT ax80 5610MHz Ant1



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5500	Ant2	5499.98	-20000	-3.64	25	Pass
NVNT	a	5580	Ant2	5580	0	0	25	Pass
NVNT	a	5700	Ant2	5699.98	-20000	-3.51	25	Pass
NVNT	n20	5500	Ant2	5500	0	0	25	Pass
NVNT	n20	5580	Ant2	5579.98	-20000	-3.58	25	Pass
NVNT	n20	5700	Ant2	5699.98	-20000	-3.51	25	Pass
NVNT	n40	5510	Ant2	5510	0	0	25	Pass
NVNT	n40	5550	Ant2	5550	0	0	25	Pass
NVNT	n40	5670	Ant2	5669.96	-40000	-7.05	25	Pass
NVNT	ac20	5500	Ant2	5499.98	-20000	-3.64	25	Pass
NVNT	ac20	5580	Ant2	5579.98	-20000	-3.58	25	Pass
NVNT	ac20	5700	Ant2	5699.98	-20000	-3.51	25	Pass
NVNT	ac40	5510	Ant2	5509.96	-40000	-7.26	25	Pass
NVNT	ac40	5550	Ant2	5549.96	-40000	-7.21	25	Pass
NVNT	ac40	5670	Ant2	5669.96	-40000	-7.05	25	Pass
NVNT	ac80	5530	Ant2	5530	0	0	25	Pass
NVNT	ac80	5610	Ant2	5610	0	0	25	Pass
NVNT	ax20	5500	Ant2	5499.96	-40000	-7.27	25	Pass
NVNT	ax20	5580	Ant2	5579.98	-20000	-3.58	25	Pass
NVNT	ax20	5700	Ant2	5700	0	0	25	Pass
NVNT	ax40	5510	Ant2	5510	0	0	25	Pass
NVNT	ax40	5550	Ant2	5549.96	-40000	-7.21	25	Pass
NVNT	ax40	5670	Ant2	5670	0	0	25	Pass
NVNT	ax80	5530	Ant2	5530	0	0	25	Pass
NVNT	ax80	5610	Ant2	5610	0	0	25	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity