




## 5MHz\_High\_16QAM\_1@24

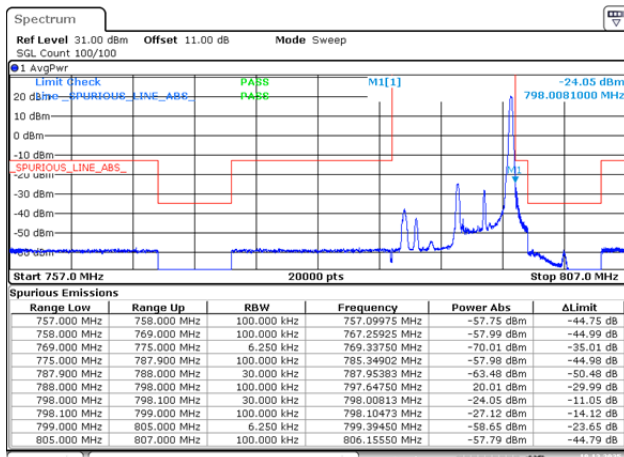


## 5MHz\_High\_16QAM\_25@0

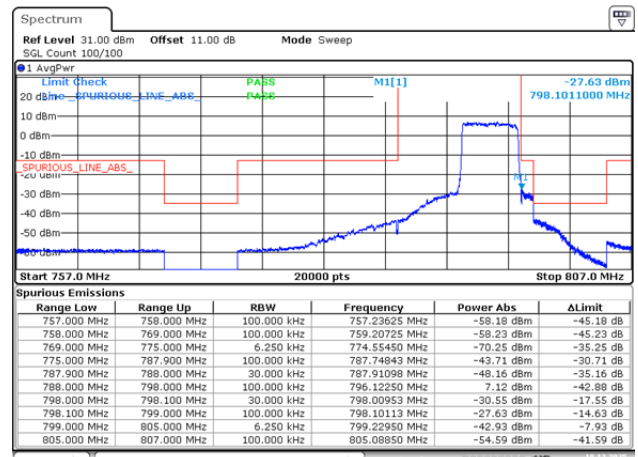


## 10MHz\_Middle\_QPSK\_1@0

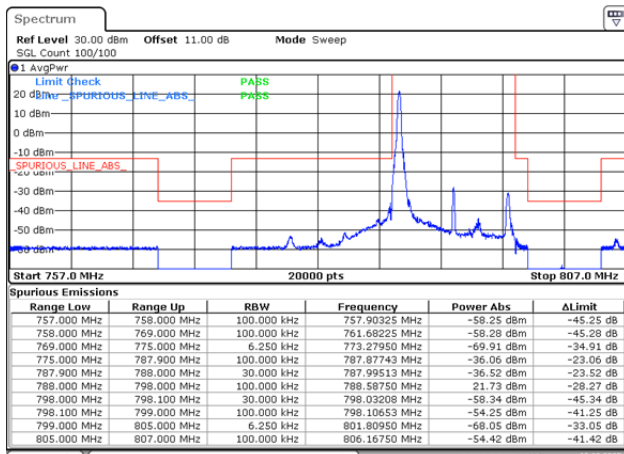


## 10MHz\_Middle\_QPSK\_1@49

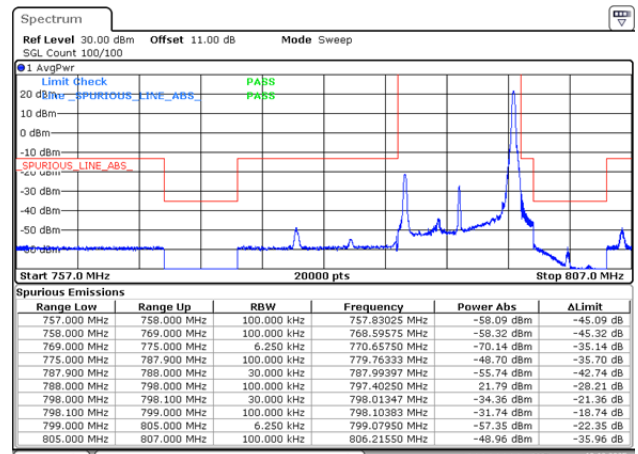


## 10MHz\_Middle\_QPSK\_50@0

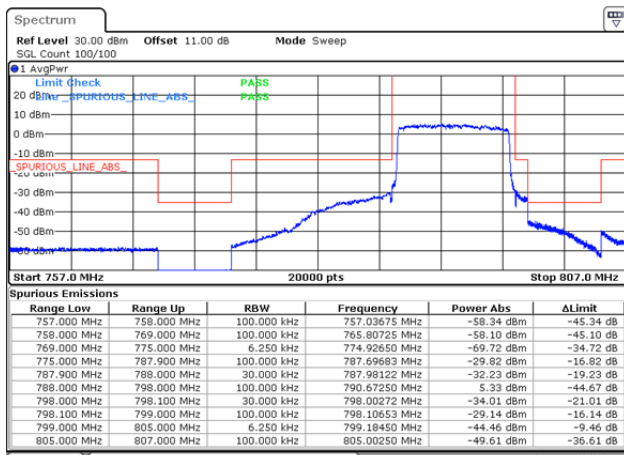

## 10MHz\_Middle\_16QAM\_1@0

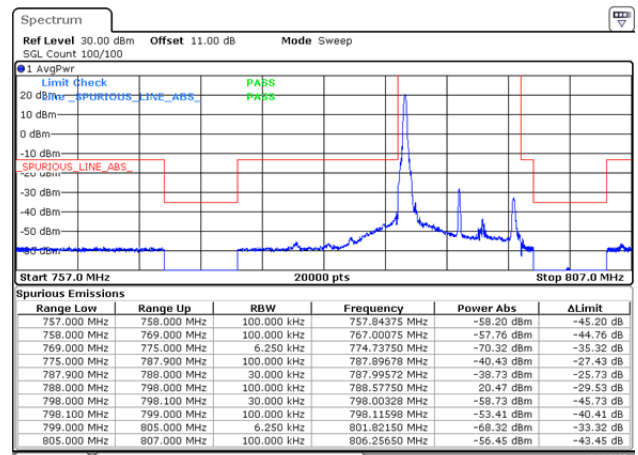


10MHz\_Middle\_16QAM\_1@49

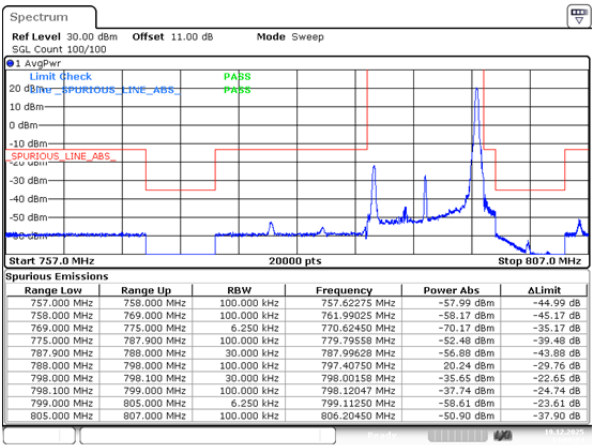

ProjectNo.:2507Z22634E-RF Tester:Braylon Ma  
Date: 19.DEC.2025 14:09:23

10MHz\_Middle\_16QAM\_50@0

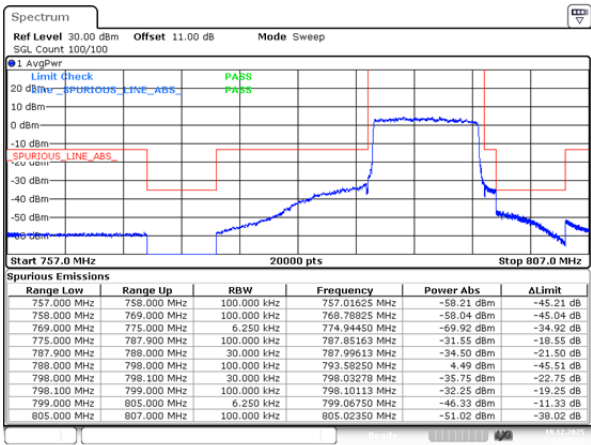

ProjectNo.:2507Z22634E-RF Tester:Braylon Ma  
Date: 19.DEC.2025 14:10:38

## Spurious Emissions at Antenna Terminal

### FCC Part 22H

#### Band 5, Normal


| Mode                                  | Value (dBm) | Limit      | Verdict |
|---------------------------------------|-------------|------------|---------|
| 1.4MHz_Low_QPSK_1@0(30MHz~9.49GHz)    | -32.94      | See Graphs | Pass    |
| 1.4MHz_Middle_QPSK_1@0(30MHz~9.49GHz) | -32.43      | See Graphs | Pass    |
| 1.4MHz_High_QPSK_1@0(30MHz~9.49GHz)   | -32.74      | See Graphs | Pass    |
| 3MHz_Low_QPSK_1@0(30MHz~9.49GHz)      | -33.02      | See Graphs | Pass    |
| 3MHz_Middle_QPSK_1@0(30MHz~9.49GHz)   | -32.82      | See Graphs | Pass    |
| 3MHz_High_QPSK_1@0(30MHz~9.49GHz)     | -32.40      | See Graphs | Pass    |
| 5MHz_Low_QPSK_1@0(30MHz~9.49GHz)      | -32.58      | See Graphs | Pass    |
| 5MHz_Middle_QPSK_1@0(30MHz~9.49GHz)   | -32.89      | See Graphs | Pass    |
| 5MHz_High_QPSK_1@0(30MHz~9.49GHz)     | -32.65      | See Graphs | Pass    |
| 10MHz_Low_QPSK_1@0(30MHz~9.49GHz)     | -32.04      | See Graphs | Pass    |
| 10MHz_Middle_QPSK_1@0(30MHz~9.49GHz)  | -33.18      | See Graphs | Pass    |
| 10MHz_High_QPSK_1@0(30MHz~9.49GHz)    | -32.71      | See Graphs | Pass    |

**Note:**1RB was the worst case.

## LTE Band 5, Normal


## 1RB was the worst case

1.4MHz\_Low\_QPSK\_1@0(30MHz~9.49GHz)

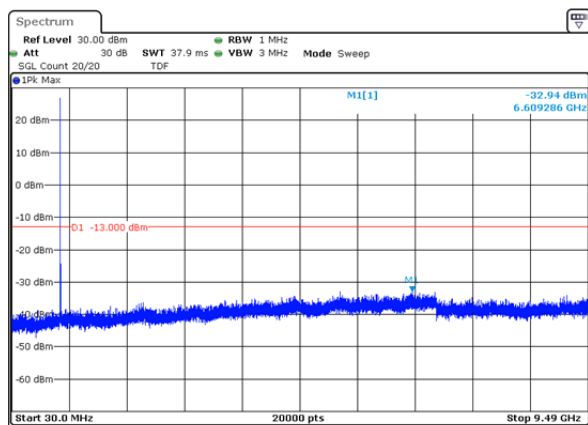


ProjectNo.: 2507Z22634E-RF Testers:Braylon Ma  
Date: 19,DEC,2025 16:27:14

1.4MHz\_Middle\_QPSK\_1@0(30MHz~9.49GHz)

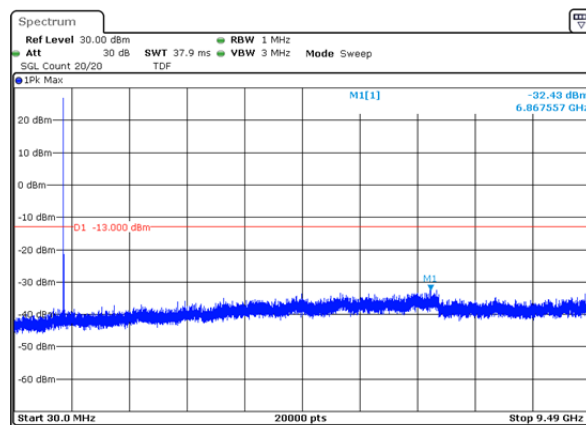


ProjectNo.: 2507Z22634E-RF Testers:Braylon Ma  
Date: 19,DEC,2025 16:27:50

1.4MHz\_High\_QPSK\_1@0(30MHz~9.49GHz)

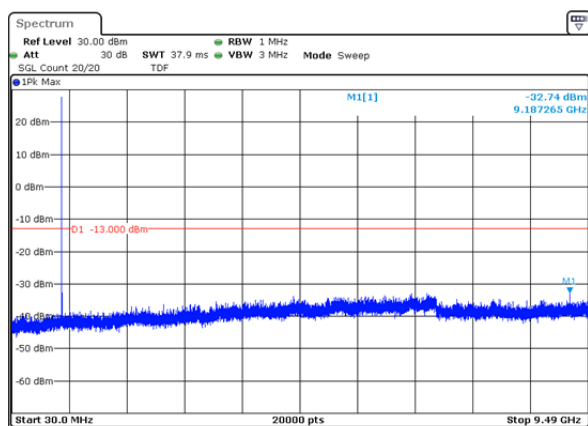


ProjectNo.: 2507Z22634E-RF Testers:Braylon Ma  
Date: 19,DEC,2025 16:28:25

3MHz\_Low\_QPSK\_1@0(30MHz~9.49GHz)

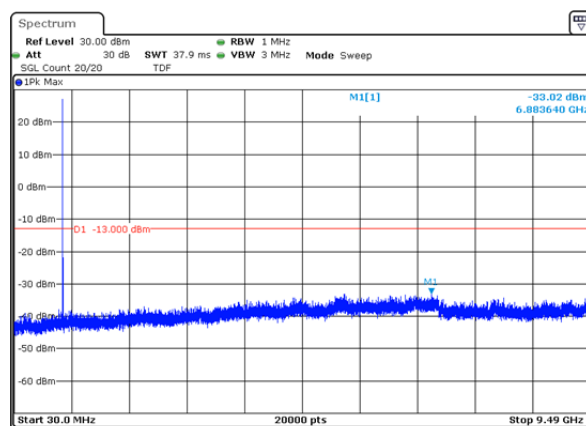


ProjectNo.: 2507Z22634E-RF Testers:Braylon Ma  
Date: 19,DEC,2025 16:29:56

3MHz\_Middle\_QPSK\_1@0(30MHz~9.49GHz)

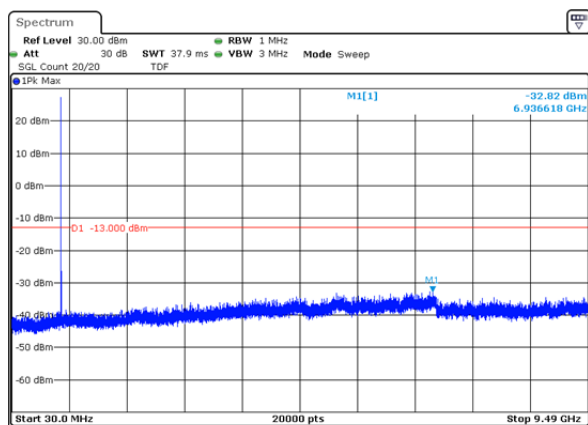


ProjectNo.: 2507Z22634E-RF Testers:Braylon Ma  
Date: 19,DEC,2025 16:30:31

3MHz\_High\_QPSK\_1@0(30MHz~9.49GHz)

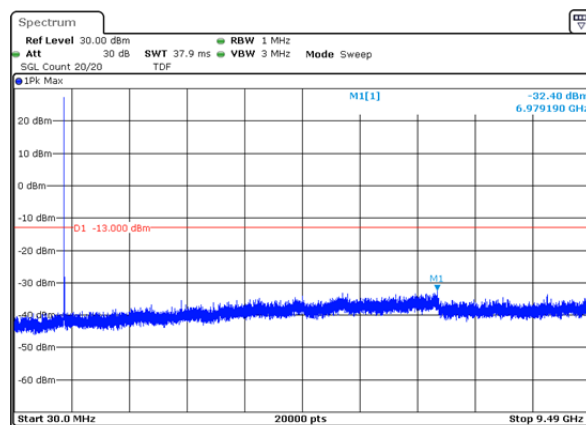


ProjectNo.: 2507Z22634E-RF Testers:Braylon Ma  
Date: 19,DEC,2025 16:31:06

5MHz\_Low\_QPSK\_1@0(30MHz~9.49GHz)

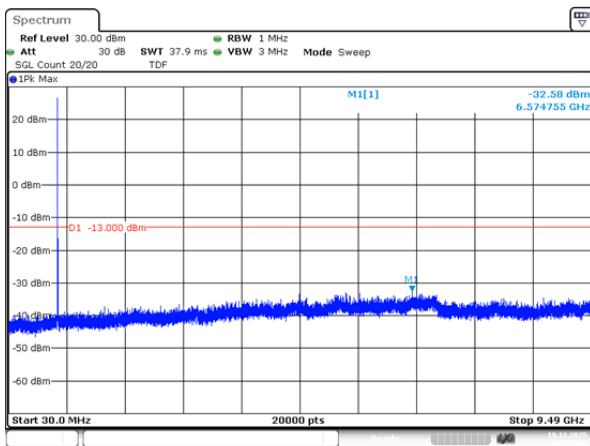


ProjectNo.: 2507Z22634E-RF Tester: Bawlyon Ma  
Date: 19.DEC.2025 16:32:35

5MHz\_Middle\_QPSK\_1@0(30MHz~9.49GHz)

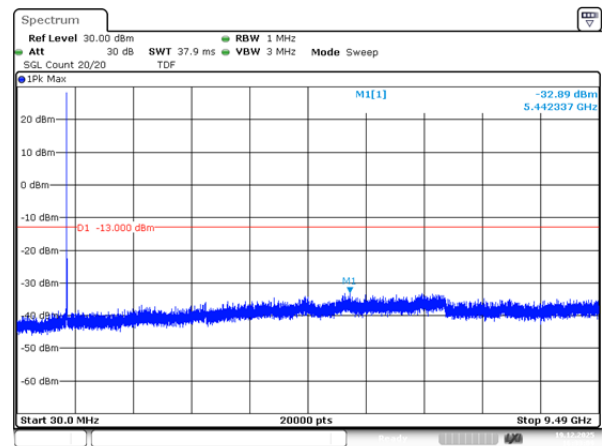


ProjectNo.: 2507Z22634E-RF Tester: Bawlyon Ma  
Date: 19.DEC.2025 16:33:10

5MHz\_High\_QPSK\_1@0(30MHz~9.49GHz)

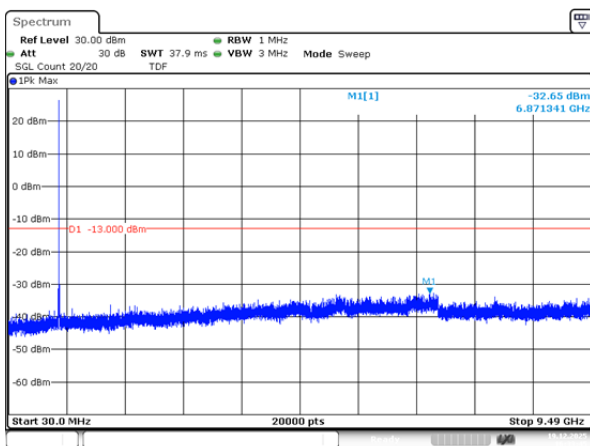


ProjectNo.: 2507Z22634E-RF Tester: Bawlyon Ma  
Date: 19.DEC.2025 16:33:45

10MHz\_Low\_QPSK\_1@0(30MHz~9.49GHz)

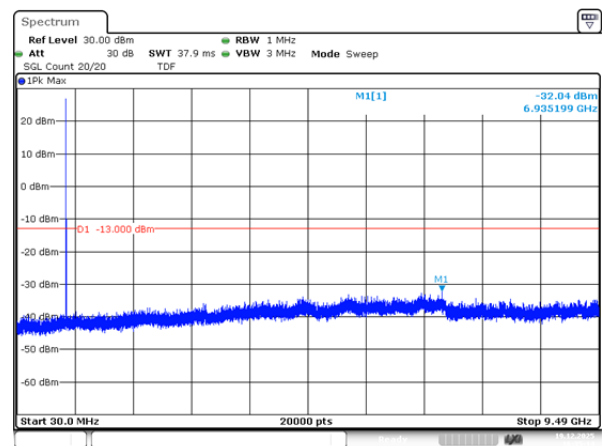


ProjectNo.: 2507Z22634E-RF Tester: Bawlyon Ma  
Date: 19.DEC.2025 16:35:13

10MHz\_Middle\_QPSK\_1@0(30MHz~9.49GHz)

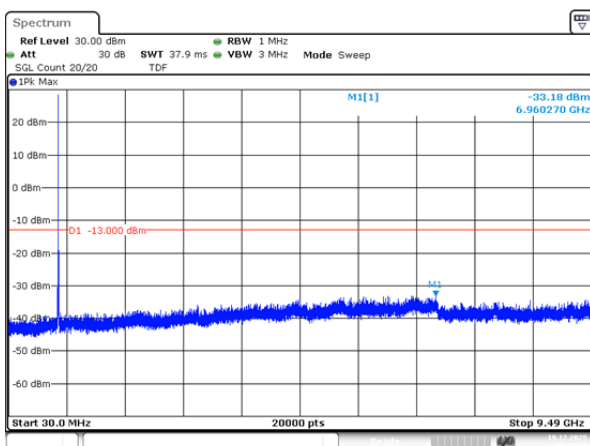

ProjectNo.: 2507Z22634E-RF Tester: Bawlyon Ma  
Date: 19.DEC.2025 16:35:49

10MHz\_High\_QPSK\_1@0(30MHz~9.49GHz)

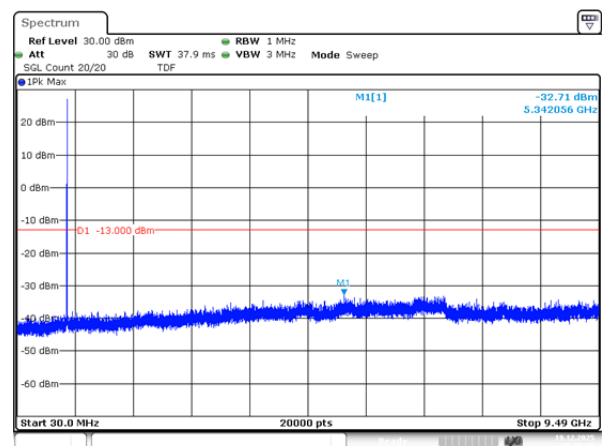

ProjectNo.: 2507Z22634E-RF Tester: Bawlyon Ma  
Date: 19.DEC.2025 16:36:25

## FCC Part 24E

## Band 2, Normal


| Mode                                  | Value (dBm) | Limit      | Verdict |
|---------------------------------------|-------------|------------|---------|
| 1.4MHz_Low_QPSK_1@0(30MHz~20.1GHz)    | -30.64      | See Graphs | Pass    |
| 1.4MHz_Middle_QPSK_1@0(30MHz~20.1GHz) | -30.58      | See Graphs | Pass    |
| 1.4MHz_High_QPSK_1@0(30MHz~20.1GHz)   | -30.20      | See Graphs | Pass    |
| 3MHz_Low_QPSK_1@0(30MHz~20.1GHz)      | -31.22      | See Graphs | Pass    |
| 3MHz_Middle_QPSK_1@0(30MHz~20.1GHz)   | -30.99      | See Graphs | Pass    |
| 3MHz_High_QPSK_1@0(30MHz~20.1GHz)     | -30.92      | See Graphs | Pass    |
| 5MHz_Low_QPSK_1@0(30MHz~20.1GHz)      | -30.70      | See Graphs | Pass    |
| 5MHz_Middle_QPSK_1@0(30MHz~20.1GHz)   | -30.93      | See Graphs | Pass    |
| 5MHz_High_QPSK_1@0(30MHz~20.1GHz)     | -31.12      | See Graphs | Pass    |
| 10MHz_Low_QPSK_1@0(30MHz~20.1GHz)     | -28.80      | See Graphs | Pass    |
| 10MHz_Middle_QPSK_1@0(30MHz~20.1GHz)  | -30.20      | See Graphs | Pass    |
| 10MHz_High_QPSK_1@0(30MHz~20.1GHz)    | -30.37      | See Graphs | Pass    |
| 15MHz_Low_QPSK_1@0(30MHz~20.1GHz)     | -30.67      | See Graphs | Pass    |
| 15MHz_Middle_QPSK_1@0(30MHz~20.1GHz)  | -30.37      | See Graphs | Pass    |
| 15MHz_High_QPSK_1@0(30MHz~20.1GHz)    | -30.67      | See Graphs | Pass    |
| 20MHz_Low_QPSK_1@0(30MHz~20.1GHz)     | -30.94      | See Graphs | Pass    |
| 20MHz_Middle_QPSK_1@0(30MHz~20.1GHz)  | -30.43      | See Graphs | Pass    |
| 20MHz_High_QPSK_1@0(30MHz~20.1GHz)    | -30.48      | See Graphs | Pass    |

**Note:1RB was the worst case.**

## LTE Band 2, Normal


## 1RB was the worst case

1.4MHz\_Low\_QPSK\_1@0(30MHz~20.1GHz)

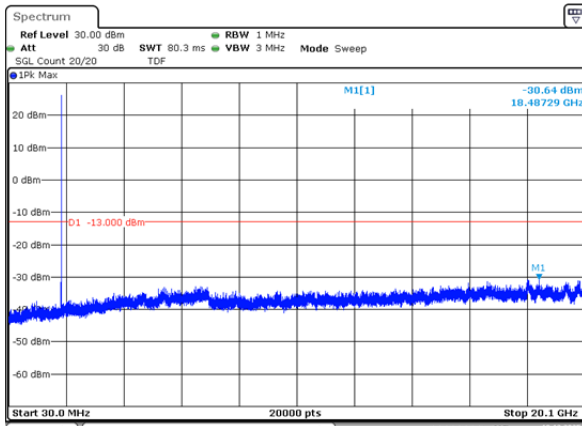


ProjectNo.: 2507Z22634E-RF Testert:Baylon Ma  
Date: 19.DEC.2025 15:47:10

1.4MHz\_Middle\_QPSK\_1@0(30MHz~20.1GHz)

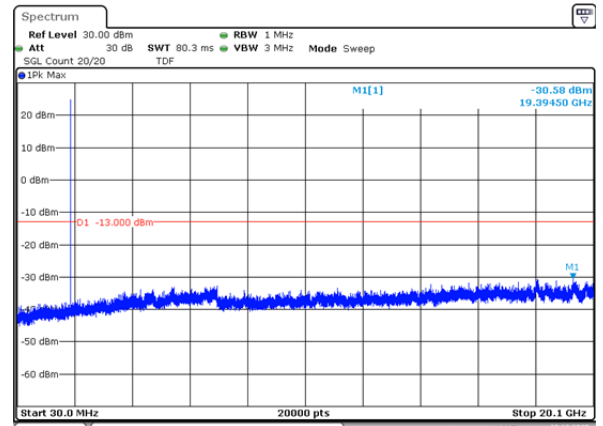


ProjectNo.: 2507Z22634E-RF Testert:Baylon Ma  
Date: 19.DEC.2025 15:47:47

1.4MHz\_High\_QPSK\_1@0(30MHz~20.1GHz)

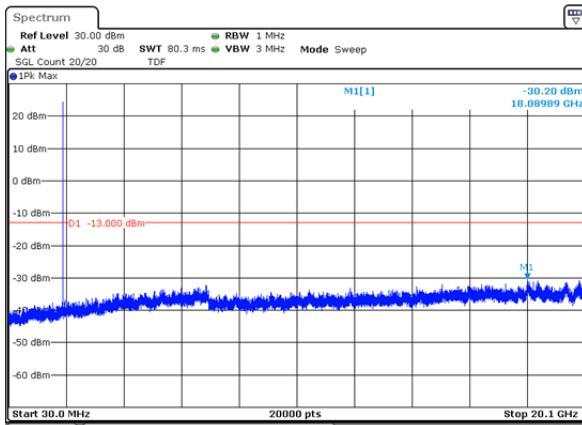


ProjectNo.: 2507Z22634E-RF Testert:Baylon Ma  
Date: 19.DEC.2025 15:48:25

3MHz\_Low\_QPSK\_1@0(30MHz~20.1GHz)

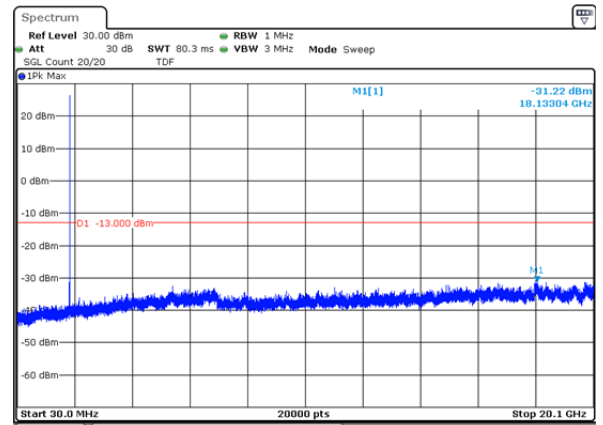


ProjectNo.: 2507Z22634E-RF Testert:Baylon Ma  
Date: 19.DEC.2025 15:53:50

3MHz\_Middle\_QPSK\_1@0(30MHz~20.1GHz)

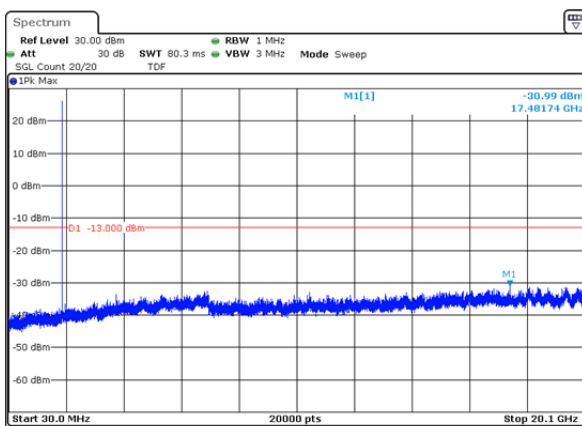


ProjectNo.: 2507Z22634E-RF Testert:Baylon Ma  
Date: 19.DEC.2025 15:54:28

3MHz\_High\_QPSK\_1@0(30MHz~20.1GHz)

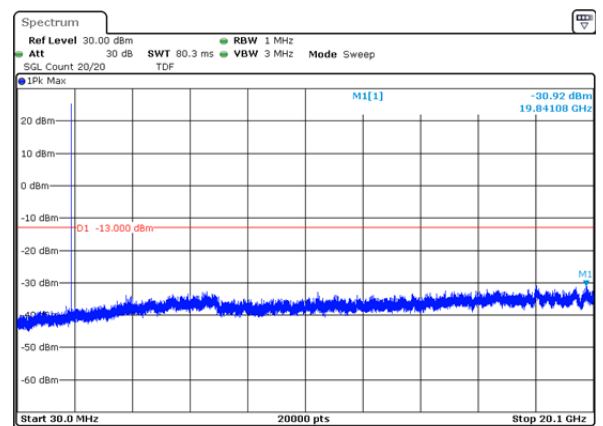


ProjectNo.: 2507Z22634E-RF Testert:Baylon Ma  
Date: 19.DEC.2025 15:55:08

5MHz\_Low\_QPSK\_1@0(30MHz~20.1GHz)

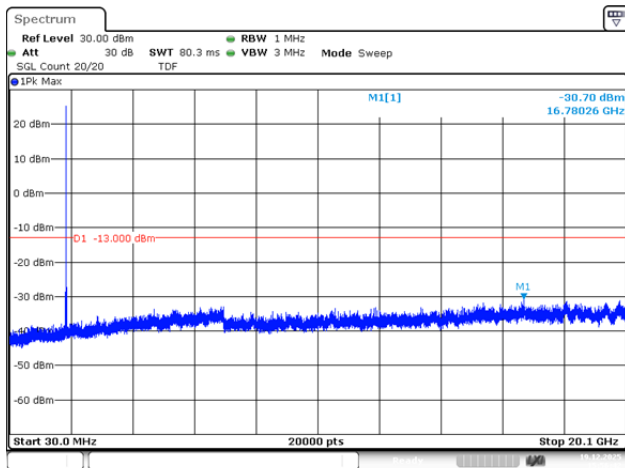


ProjectNo.: 2507Z22634E-RF Tester:Braylon Ma  
Date: 19.DEC.2025 15:56:42

5MHz\_Middle\_QPSK\_1@0(30MHz~20.1GHz)

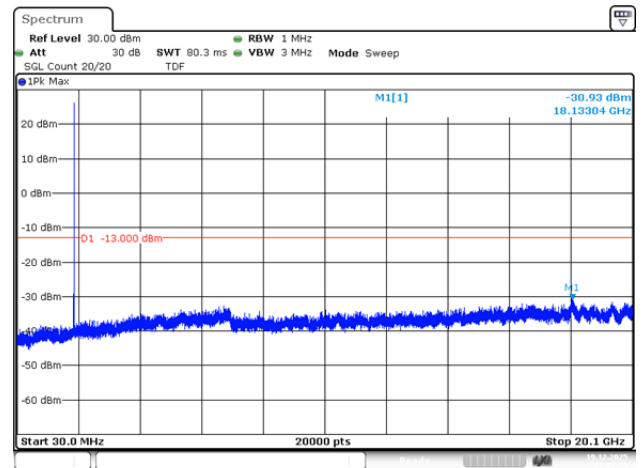


ProjectNo.: 2507Z22634E-RF Tester:Braylon Ma  
Date: 19.DEC.2025 15:57:29

5MHz\_High\_QPSK\_1@0(30MHz~20.1GHz)

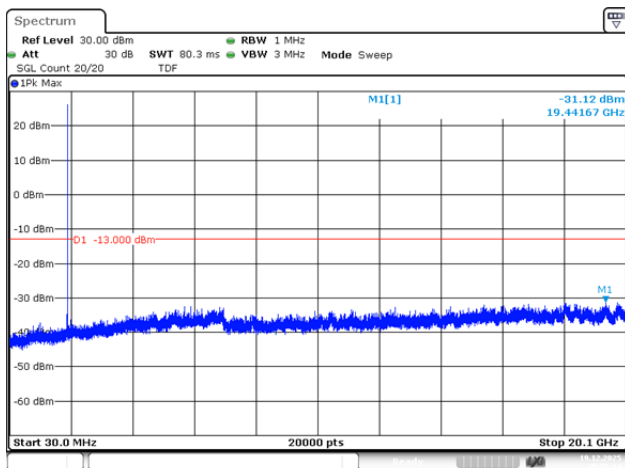


ProjectNo.: 2507Z22634E-RF Tester:Braylon Ma  
Date: 19.DEC.2025 15:58:14

10MHz\_Low\_QPSK\_1@0(30MHz~20.1GHz)

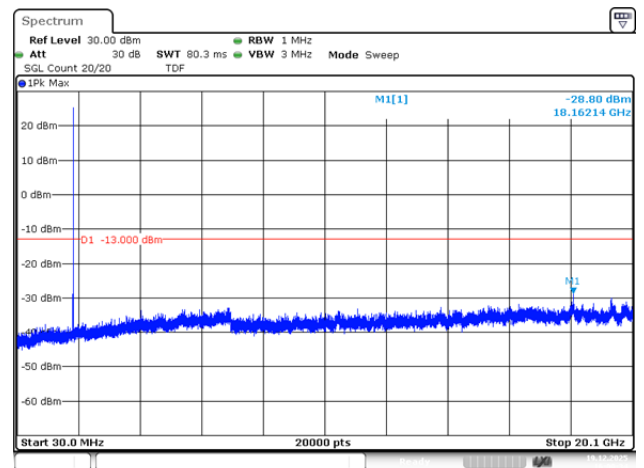


ProjectNo.: 2507Z22634E-RF Tester:Braylon Ma  
Date: 19.DEC.2025 16:00:34

10MHz\_Middle\_QPSK\_1@0(30MHz~20.1GHz)

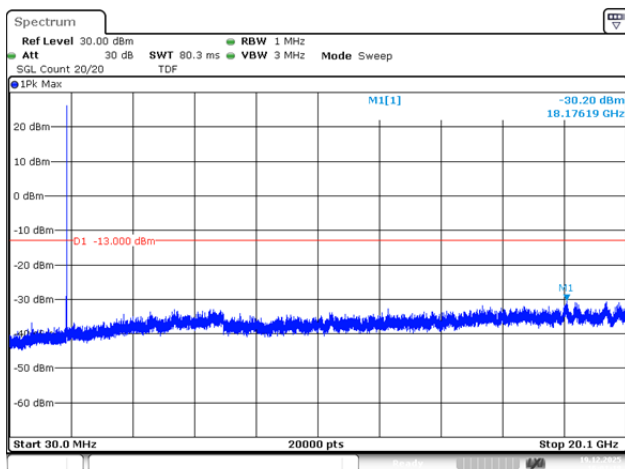


ProjectNo.: 2507Z22634E-RF Tester:Braylon Ma  
Date: 19.DEC.2025 16:01:18

10MHz\_High\_QPSK\_1@0(30MHz~20.1GHz)

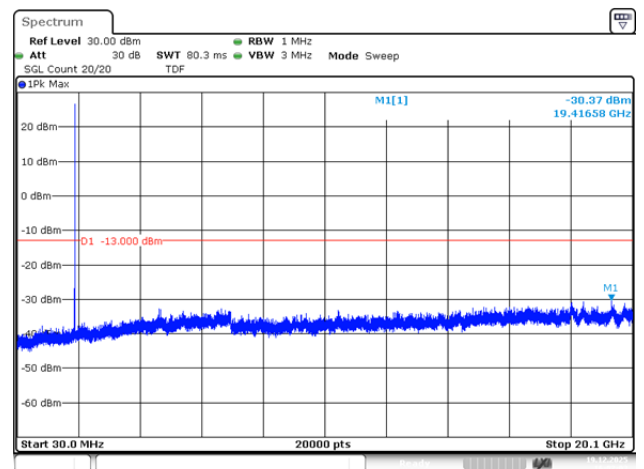


ProjectNo.: 2507Z22634E-RF Tester:Braylon Ma  
Date: 19.DEC.2025 16:02:02

15MHz\_Low\_QPSK\_1@0(30MHz~20.1GHz)

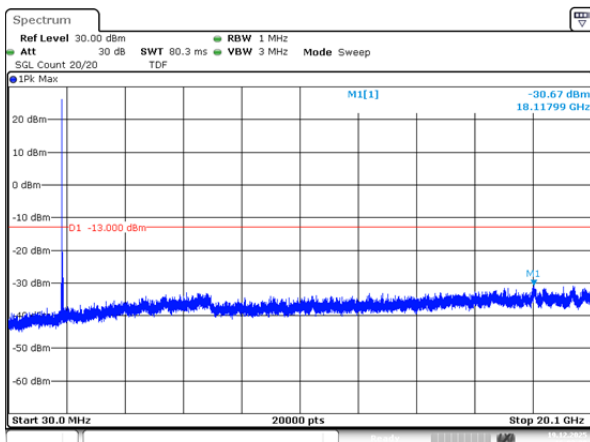


ProjectNo.: 2507Z22634E-RF Tester: Baylon Ma  
Date: 19.DEC.2025 16:03:39

15MHz\_Middle\_QPSK\_1@0(30MHz~20.1GHz)

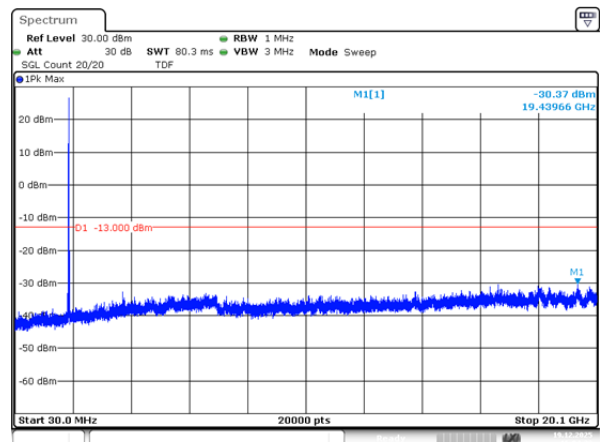


ProjectNo.: 2507Z22634E-RF Tester: Baylon Ma  
Date: 19.DEC.2025 16:04:23

15MHz\_High\_QPSK\_1@0(30MHz~20.1GHz)

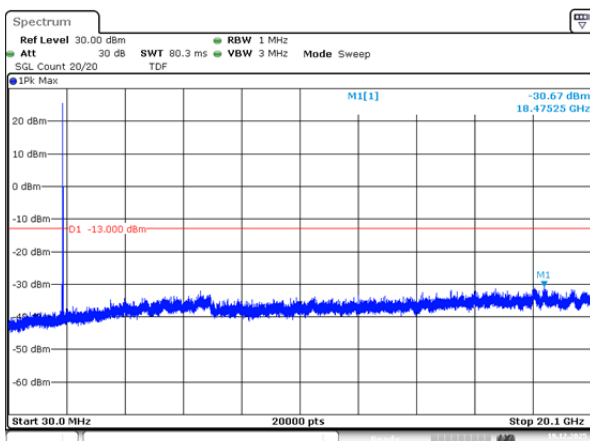


ProjectNo.: 2507Z22634E-RF Tester: Baylon Ma  
Date: 19.DEC.2025 16:05:05

20MHz\_Low\_QPSK\_1@0(30MHz~20.1GHz)

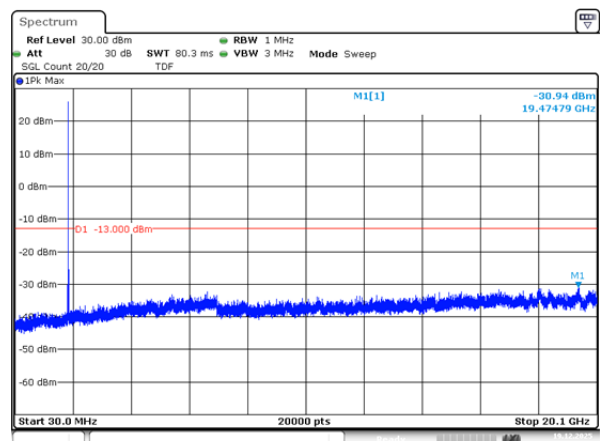


ProjectNo.: 2507Z22634E-RF Tester: Baylon Ma  
Date: 19.DEC.2025 16:06:42

20MHz\_Middle\_QPSK\_1@0(30MHz~20.1GHz)

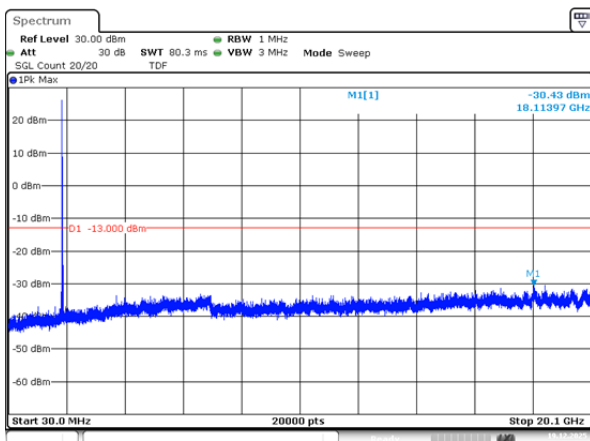

ProjectNo.: 2507Z22634E-RF Tester: Baylon Ma  
Date: 19.DEC.2025 16:07:25

20MHz\_High\_QPSK\_1@0(30MHz~20.1GHz)

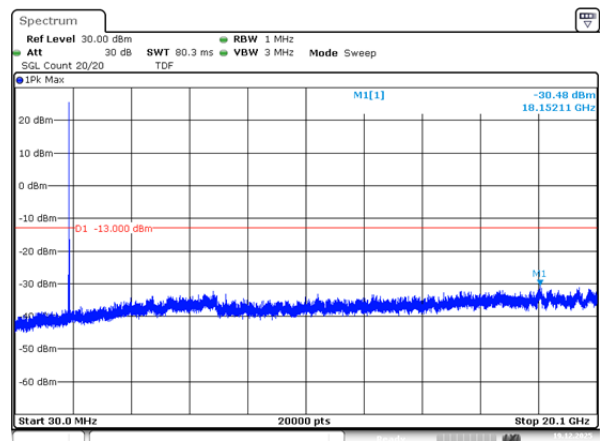

ProjectNo.: 2507Z22634E-RF Tester: Baylon Ma  
Date: 19.DEC.2025 16:08:08

## FCC Part 27

## LTE Band 4, Normal

| Mode                                   | Value (dBm) | Limit      | Verdict |
|----------------------------------------|-------------|------------|---------|
| 1.4MHz_Low_QPSK_1@0(30MHz~18.55GHz)    | -29.72      | See Graphs | Pass    |
| 1.4MHz_Middle_QPSK_1@0(30MHz~18.55GHz) | -30.68      | See Graphs | Pass    |
| 1.4MHz_High_QPSK_1@0(30MHz~18.55GHz)   | -31.44      | See Graphs | Pass    |
| 3MHz_Low_QPSK_1@0(30MHz~18.55GHz)      | -31.47      | See Graphs | Pass    |
| 3MHz_Middle_QPSK_1@0(30MHz~18.55GHz)   | -30.36      | See Graphs | Pass    |
| 3MHz_High_QPSK_1@0(30MHz~18.55GHz)     | -31.28      | See Graphs | Pass    |
| 5MHz_Low_QPSK_1@0(30MHz~18.55GHz)      | -30.39      | See Graphs | Pass    |
| 5MHz_Middle_QPSK_1@0(30MHz~18.55GHz)   | -30.68      | See Graphs | Pass    |
| 5MHz_High_QPSK_1@0(30MHz~18.55GHz)     | -30.26      | See Graphs | Pass    |
| 10MHz_Low_QPSK_1@0(30MHz~18.55GHz)     | -30.81      | See Graphs | Pass    |
| 10MHz_Middle_QPSK_1@0(30MHz~18.55GHz)  | -30.78      | See Graphs | Pass    |
| 10MHz_High_QPSK_1@0(30MHz~18.55GHz)    | -30.20      | See Graphs | Pass    |
| 15MHz_Low_QPSK_1@0(30MHz~18.55GHz)     | -31.02      | See Graphs | Pass    |
| 15MHz_Middle_QPSK_1@0(30MHz~18.55GHz)  | -30.92      | See Graphs | Pass    |
| 15MHz_High_QPSK_1@0(30MHz~18.55GHz)    | -31.33      | See Graphs | Pass    |
| 20MHz_Low_QPSK_1@0(30MHz~18.55GHz)     | -31.01      | See Graphs | Pass    |
| 20MHz_Middle_QPSK_1@0(30MHz~18.55GHz)  | -31.27      | See Graphs | Pass    |
| 20MHz_High_QPSK_1@0(30MHz~18.55GHz)    | -31.10      | See Graphs | Pass    |

## LTE Band 12, Normal

| Mode                                  | Value (dBm) | Limit      | Verdict |
|---------------------------------------|-------------|------------|---------|
| 1.4MHz_Low_QPSK_1@0(30MHz~8.16GHz)    | -32.80      | See Graphs | Pass    |
| 1.4MHz_Middle_QPSK_1@0(30MHz~8.16GHz) | -31.62      | See Graphs | Pass    |
| 1.4MHz_High_QPSK_1@0(30MHz~8.16GHz)   | -32.85      | See Graphs | Pass    |
| 3MHz_Low_QPSK_1@0(30MHz~8.16GHz)      | -32.39      | See Graphs | Pass    |
| 3MHz_Middle_QPSK_1@0(30MHz~8.16GHz)   | -32.46      | See Graphs | Pass    |
| 3MHz_High_QPSK_1@0(30MHz~8.16GHz)     | -31.59      | See Graphs | Pass    |
| 5MHz_Low_QPSK_1@0(30MHz~8.16GHz)      | -32.39      | See Graphs | Pass    |
| 5MHz_Middle_QPSK_1@0(30MHz~8.16GHz)   | -32.80      | See Graphs | Pass    |
| 5MHz_High_QPSK_1@0(30MHz~8.16GHz)     | -32.56      | See Graphs | Pass    |
| 10MHz_Low_QPSK_1@0(30MHz~8.16GHz)     | -32.76      | See Graphs | Pass    |
| 10MHz_Middle_QPSK_1@0(30MHz~8.16GHz)  | -32.38      | See Graphs | Pass    |
| 10MHz_High_QPSK_1@0(30MHz~8.16GHz)    | -33.03      | See Graphs | Pass    |

**LTE Band 13, Normal**

| Mode                                   | Value (dBm) | Limit      | Verdict |
|----------------------------------------|-------------|------------|---------|
| 5MHz_Low_QPSK_1@0(30MHz~8.87GHz)       | -32.50      | See Graphs | Pass    |
| 5MHz_Low_QPSK_1@0(763MHz~775MHz)       | -50.71      | See Graphs | Pass    |
| 5MHz_Low_QPSK_1@0(793MHz~806MHz)       | -58.37      | See Graphs | Pass    |
| 5MHz_Low_QPSK_1@0(1559MHz~1610MHz)     | -50.69      | See Graphs | Pass    |
| 5MHz_High_QPSK_1@0(30MHz~8.87GHz)      | -32.34      | See Graphs | Pass    |
| 5MHz_High_QPSK_1@0(763MHz~775MHz)      | -55.83      | See Graphs | Pass    |
| 5MHz_High_QPSK_1@0(793MHz~806MHz)      | -58.38      | See Graphs | Pass    |
| 5MHz_High_QPSK_1@0(1559MHz~1610MHz)    | -50.37      | See Graphs | Pass    |
| 10MHz_Middle_QPSK_1@0(30MHz~8.87GHz)   | -32.34      | See Graphs | Pass    |
| 10MHz_Middle_QPSK_1@0(763MHz~775MHz)   | -51.74      | See Graphs | Pass    |
| 10MHz_Middle_QPSK_1@0(793MHz~806MHz)   | -51.77      | See Graphs | Pass    |
| 10MHz_Middle_QPSK_1@0(1559MHz~1610MHz) | -50.30      | See Graphs | Pass    |

**LTE Band 66, Normal**

| Mode                                  | Value (dBm) | Limit      | Verdict |
|---------------------------------------|-------------|------------|---------|
| 1.4MHz_Low_QPSK_1@0(30MHz~18.8GHz)    | -30.70      | See Graphs | Pass    |
| 1.4MHz_Middle_QPSK_1@0(30MHz~18.8GHz) | -30.83      | See Graphs | Pass    |
| 1.4MHz_High_QPSK_1@0(30MHz~18.8GHz)   | -31.12      | See Graphs | Pass    |
| 3MHz_Low_QPSK_1@0(30MHz~18.8GHz)      | -30.69      | See Graphs | Pass    |
| 3MHz_Middle_QPSK_1@0(30MHz~18.8GHz)   | -30.47      | See Graphs | Pass    |
| 3MHz_High_QPSK_1@0(30MHz~18.8GHz)     | -30.60      | See Graphs | Pass    |
| 5MHz_Low_QPSK_1@0(30MHz~18.8GHz)      | -29.86      | See Graphs | Pass    |
| 5MHz_Middle_QPSK_1@0(30MHz~18.8GHz)   | -30.73      | See Graphs | Pass    |
| 5MHz_High_QPSK_1@0(30MHz~18.8GHz)     | -30.67      | See Graphs | Pass    |
| 10MHz_Low_QPSK_1@0(30MHz~18.8GHz)     | -30.35      | See Graphs | Pass    |
| 10MHz_Middle_QPSK_1@0(30MHz~18.8GHz)  | -30.67      | See Graphs | Pass    |
| 10MHz_High_QPSK_1@0(30MHz~18.8GHz)    | -29.48      | See Graphs | Pass    |
| 15MHz_Low_QPSK_1@0(30MHz~18.8GHz)     | -29.77      | See Graphs | Pass    |

| Mode                                 | Value (dBm) | Limit      | Verdict |
|--------------------------------------|-------------|------------|---------|
| 15MHz_Middle_QPSK_1@0(30MHz~18.8GHz) | -30.33      | See Graphs | Pass    |
| 15MHz_High_QPSK_1@0(30MHz~18.8GHz)   | -29.69      | See Graphs | Pass    |
| 20MHz_Low_QPSK_1@0(30MHz~18.8GHz)    | -29.62      | See Graphs | Pass    |
| 20MHz_Middle_QPSK_1@0(30MHz~18.8GHz) | -31.48      | See Graphs | Pass    |
| 20MHz_High_QPSK_1@0(30MHz~18.8GHz)   | -29.74      | See Graphs | Pass    |

**LTE Band 71, Normal**


| Mode                                 | Value (dBm) | Limit      | Verdict |
|--------------------------------------|-------------|------------|---------|
| 5MHz_Low_QPSK_1@0(30MHz~7.98GHz)     | -33.21      | See Graphs | Pass    |
| 5MHz_Middle_QPSK_1@0(30MHz~7.98GHz)  | -32.84      | See Graphs | Pass    |
| 5MHz_High_QPSK_1@0(30MHz~7.98GHz)    | -32.86      | See Graphs | Pass    |
| 10MHz_Low_QPSK_1@0(30MHz~7.98GHz)    | -32.81      | See Graphs | Pass    |
| 10MHz_Middle_QPSK_1@0(30MHz~7.98GHz) | -33.27      | See Graphs | Pass    |
| 10MHz_High_QPSK_1@0(30MHz~7.98GHz)   | -33.14      | See Graphs | Pass    |
| 15MHz_Low_QPSK_1@0(30MHz~7.98GHz)    | -33.23      | See Graphs | Pass    |
| 15MHz_Middle_QPSK_1@0(30MHz~7.98GHz) | -32.09      | See Graphs | Pass    |
| 15MHz_High_QPSK_1@0(30MHz~7.98GHz)   | -33.05      | See Graphs | Pass    |
| 20MHz_Low_QPSK_1@0(30MHz~7.98GHz)    | -32.87      | See Graphs | Pass    |
| 20MHz_Middle_QPSK_1@0(30MHz~7.98GHz) | -31.26      | See Graphs | Pass    |
| 20MHz_High_QPSK_1@0(30MHz~7.98GHz)   | -32.95      | See Graphs | Pass    |

**Note:1RB was the worst case.**

## LTE Band 4, Normal


## 1RB was the worst case

1.4MHz\_Low\_QPSK\_1@0(30MHz~18.55GHz)

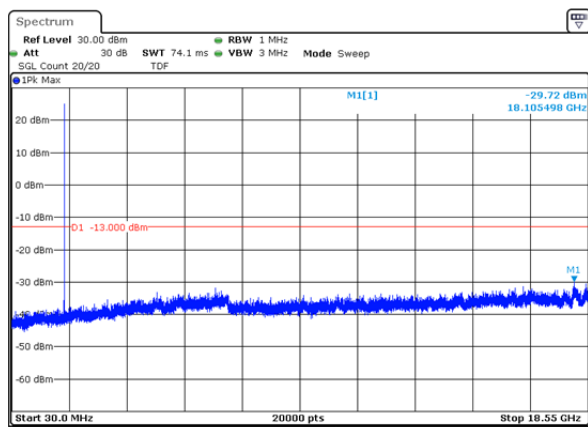


ProjectNo.: 2507Z22634E-RF Testers:Braylon Ma  
Date: 19.DEC.2025 16:09:08

1.4MHz\_Middle\_QPSK\_1@0(30MHz~18.55GHz)

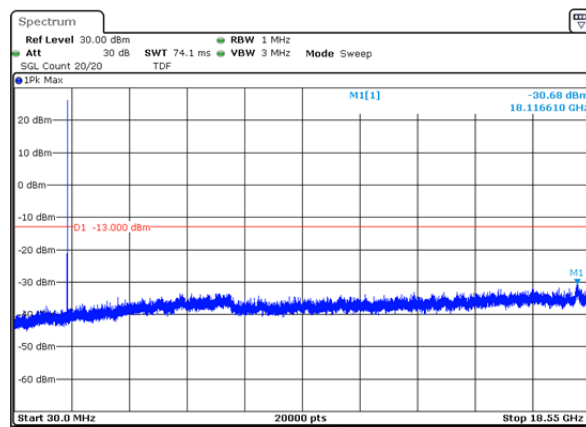


ProjectNo.: 2507Z22634E-RF Testers:Braylon Ma  
Date: 19.DEC.2025 16:09:52

1.4MHz\_High\_QPSK\_1@0(30MHz~18.55GHz)

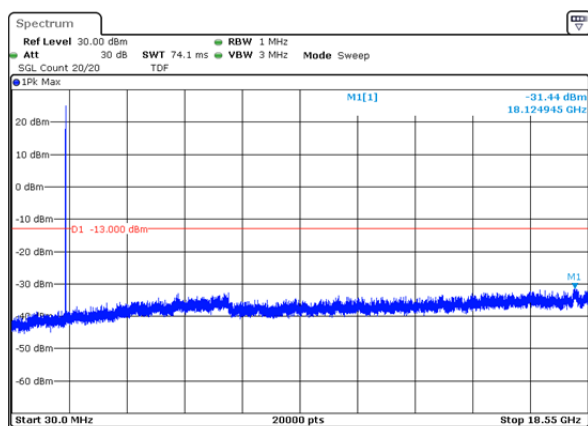


ProjectNo.: 2507Z22634E-RF Testers:Braylon Ma  
Date: 19.DEC.2025 16:10:45

3MHz\_Low\_QPSK\_1@0(30MHz~18.55GHz)

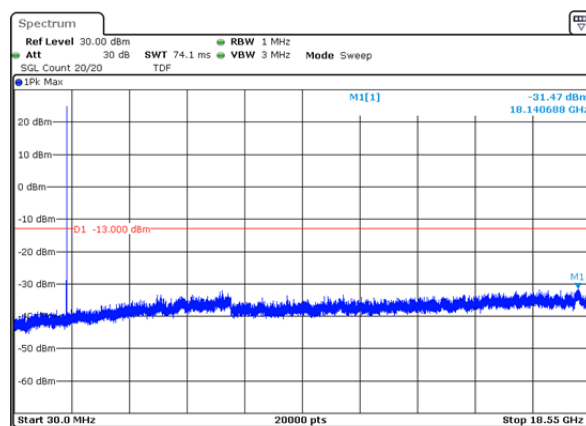


ProjectNo.: 2507Z22634E-RF Testers:Braylon Ma  
Date: 19.DEC.2025 16:12:18

3MHz\_Middle\_QPSK\_1@0(30MHz~18.55GHz)

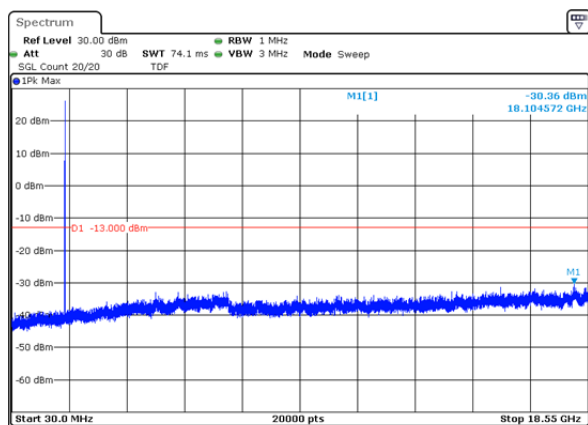


ProjectNo.: 2507Z22634E-RF Testers:Braylon Ma  
Date: 19.DEC.2025 16:12:59

3MHz\_High\_QPSK\_1@0(30MHz~18.55GHz)

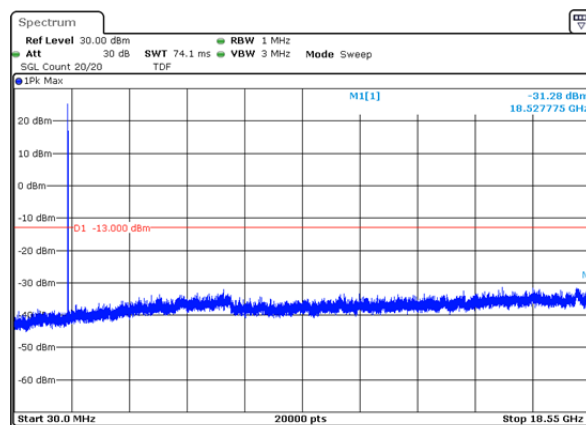


ProjectNo.: 2507Z22634E-RF Testers:Braylon Ma  
Date: 19.DEC.2025 16:13:41

5MHz\_Low\_QPSK\_1@0(30MHz~18.55GHz)

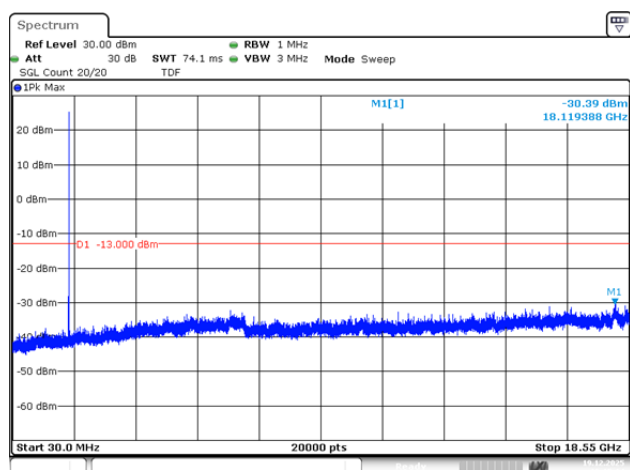


ProjectNo.: 2507Z22634E-RF Tester:Braylon Ma  
Date: 19.DEC.2025 16:15:14

5MHz\_Middle\_QPSK\_1@0(30MHz~18.55GHz)

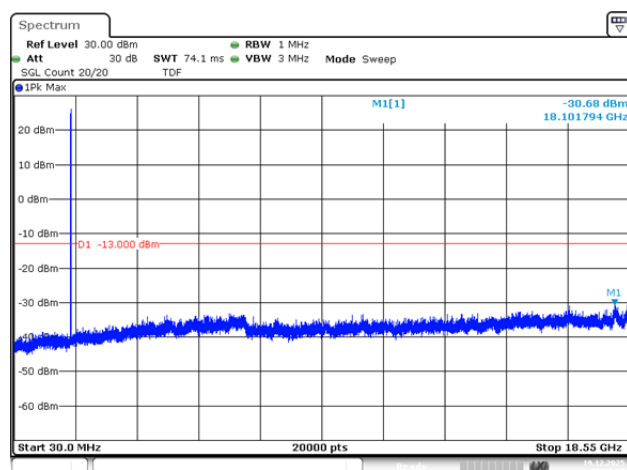


ProjectNo.: 2507Z22634E-RF Tester:Braylon Ma  
Date: 19.DEC.2025 16:15:55

5MHz\_High\_QPSK\_1@0(30MHz~18.55GHz)

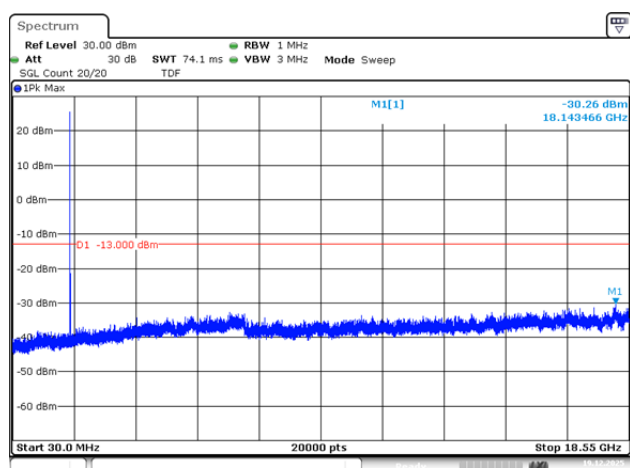


ProjectNo.: 2507Z22634E-RF Tester:Braylon Ma  
Date: 19.DEC.2025 16:16:37

10MHz\_Low\_QPSK\_1@0(30MHz~18.55GHz)

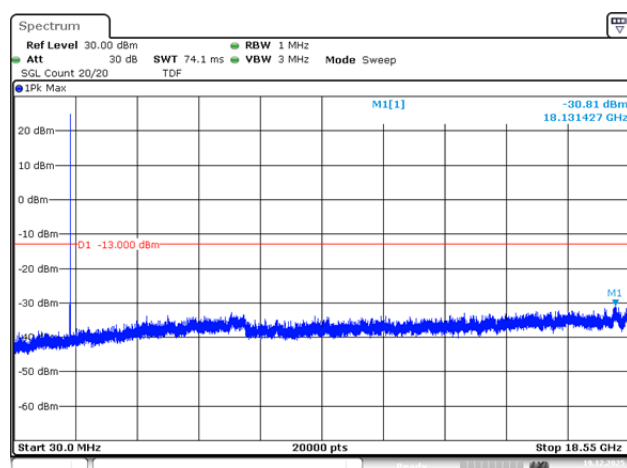


ProjectNo.: 2507Z22634E-RF Tester:Braylon Ma  
Date: 19.DEC.2025 16:18:13

10MHz\_Middle\_QPSK\_1@0(30MHz~18.55GHz)

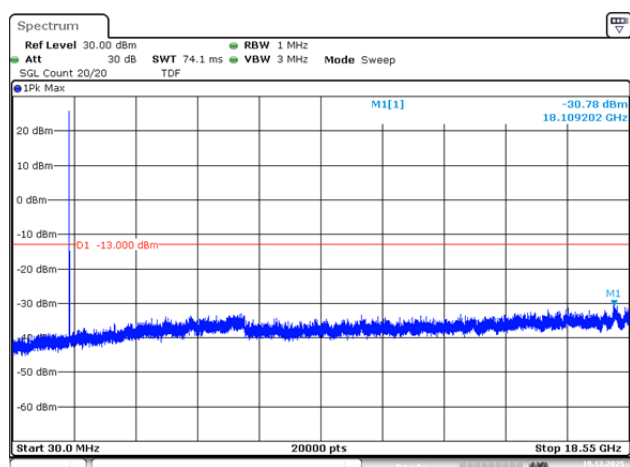


ProjectNo.: 2507Z22634E-RF Tester:Braylon Ma  
Date: 19.DEC.2025 16:18:55

10MHz\_High\_QPSK\_1@0(30MHz~18.55GHz)

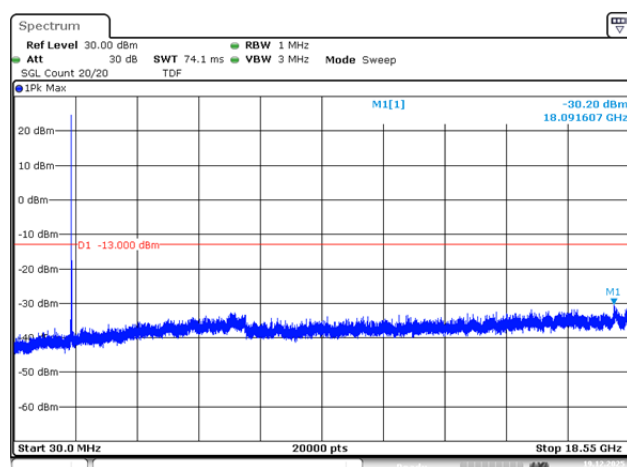


ProjectNo.: 2507Z22634E-RF Tester:Braylon Ma  
Date: 19.DEC.2025 16:19:37

15MHz\_Low\_QPSK\_1@0(30MHz~18.55GHz)

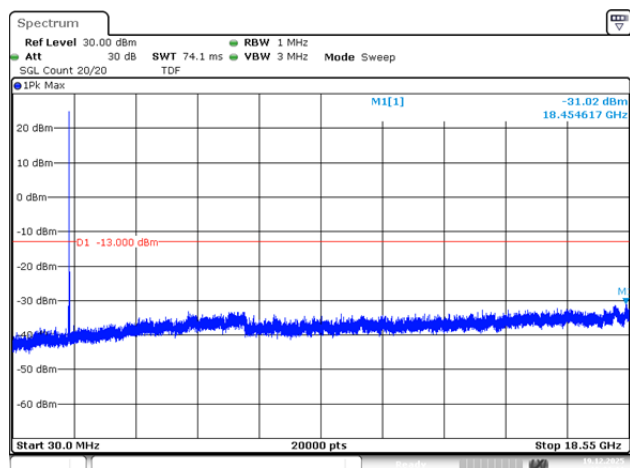


ProjectNo.: 2507Z22634E-RF Tester: Braylon Ma  
Date: 19.DEC.2025 16:21:11

15MHz\_Middle\_QPSK\_1@0(30MHz~18.55GHz)

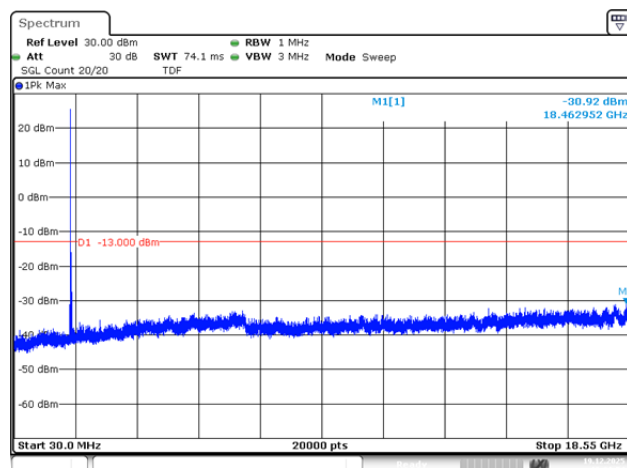


ProjectNo.: 2507Z22634E-RF Tester: Braylon Ma  
Date: 19.DEC.2025 16:21:54

15MHz\_High\_QPSK\_1@0(30MHz~18.55GHz)

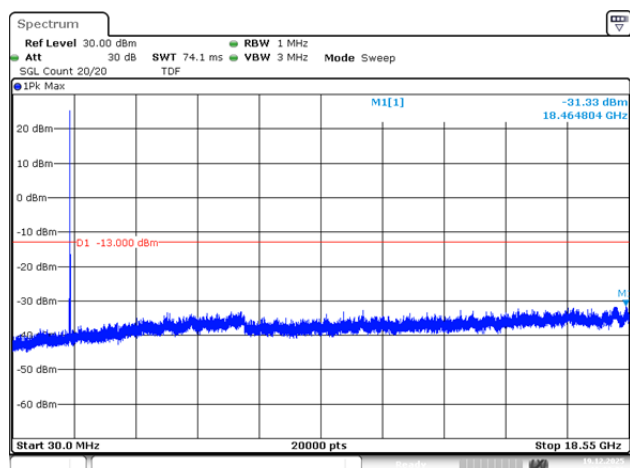


ProjectNo.: 2507Z22634E-RF Tester: Braylon Ma  
Date: 19.DEC.2025 16:22:36

20MHz\_Low\_QPSK\_1@0(30MHz~18.55GHz)

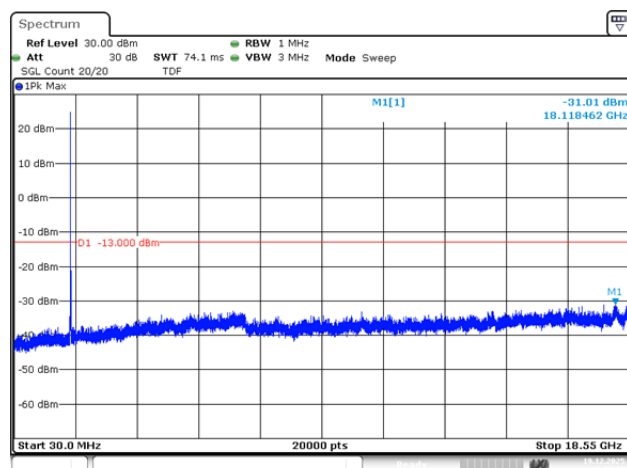


ProjectNo.: 2507Z22634E-RF Tester: Braylon Ma  
Date: 19.DEC.2025 16:24:09

20MHz\_Middle\_QPSK\_1@0(30MHz~18.55GHz)

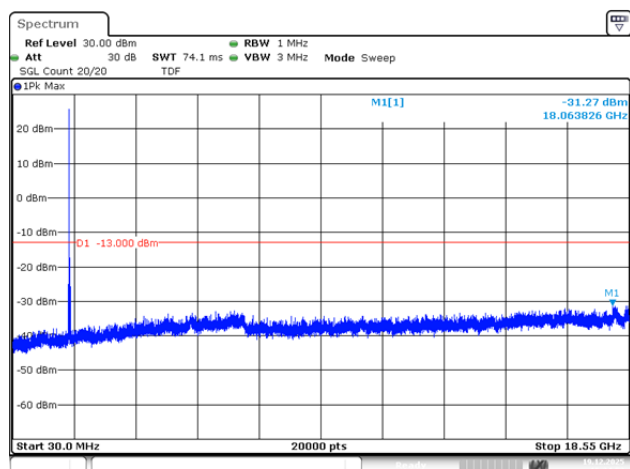

ProjectNo.: 2507Z22634E-RF Tester: Braylon Ma  
Date: 19.DEC.2025 16:24:52

20MHz\_High\_QPSK\_1@0(30MHz~18.55GHz)

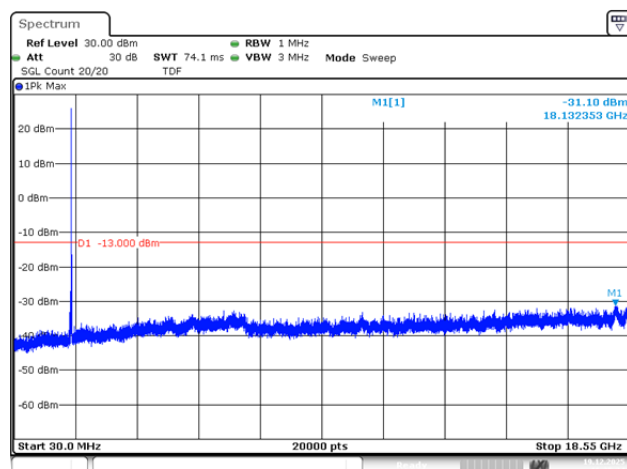


ProjectNo.: 2507Z22634E-RF Tester: Braylon Ma  
Date: 19.DEC.2025 16:25:33

## LTE Band 12, Normal


## 1RB was the worst case

1.4MHz\_Low\_QPSK\_1@0(30MHz~8.16GHz)

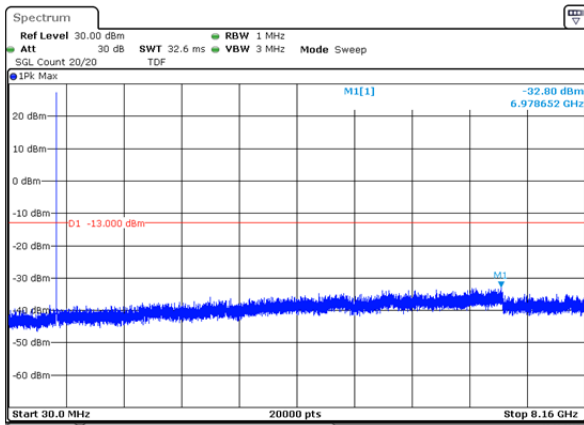


ProjectNo.: 2507Z22634E-RF Testers: Baylon Ma  
Date: 19, DEC, 2025 16:37:17

1.4MHz\_Middle\_QPSK\_1@0(30MHz~8.16GHz)

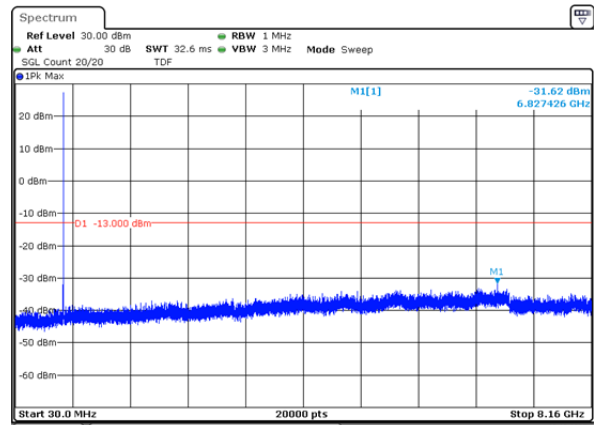


ProjectNo.: 2507Z22634E-RF Testers: Baylon Ma  
Date: 19, DEC, 2025 16:37:51

1.4MHz\_High\_QPSK\_1@0(30MHz~8.16GHz)

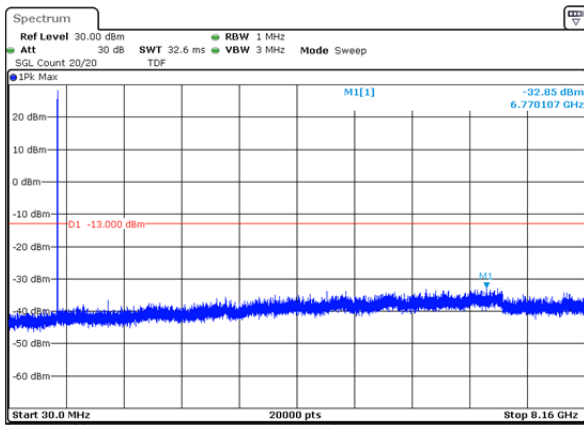


ProjectNo.: 2507Z22634E-RF Testers: Baylon Ma  
Date: 23, DEC, 2025 11:29:49

3MHz\_Low\_QPSK\_1@0(30MHz~8.16GHz)

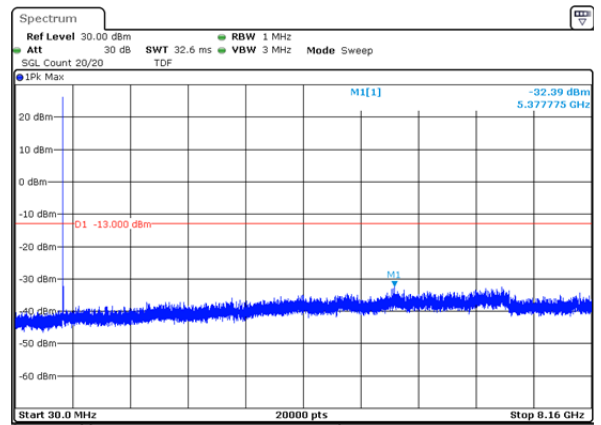


ProjectNo.: 2507Z22634E-RF Testers: Baylon Ma  
Date: 19, DEC, 2025 16:40:09

3MHz\_Middle\_QPSK\_1@0(30MHz~8.16GHz)

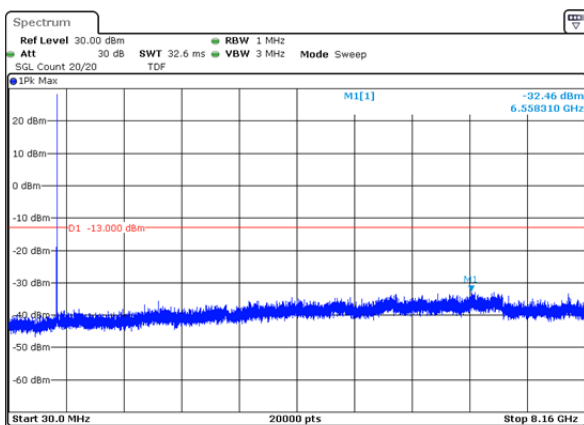


ProjectNo.: 2507Z22634E-RF Testers: Baylon Ma  
Date: 19, DEC, 2025 16:40:43

3MHz\_High\_QPSK\_1@0(30MHz~8.16GHz)

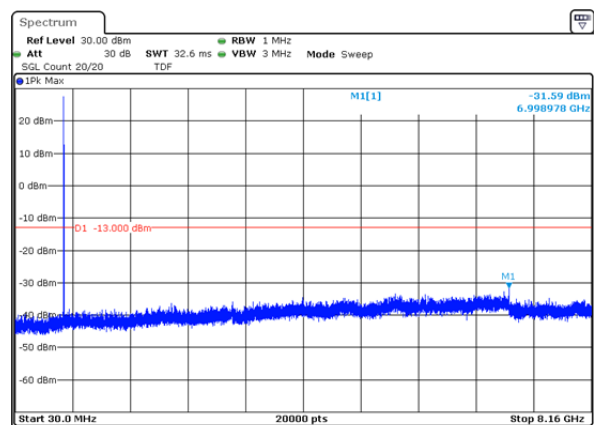


ProjectNo.: 2507Z22634E-RF Testers: Baylon Ma  
Date: 19, DEC, 2025 16:41:17

5MHz\_Low\_QPSK\_1@0(30MHz~8.16GHz)

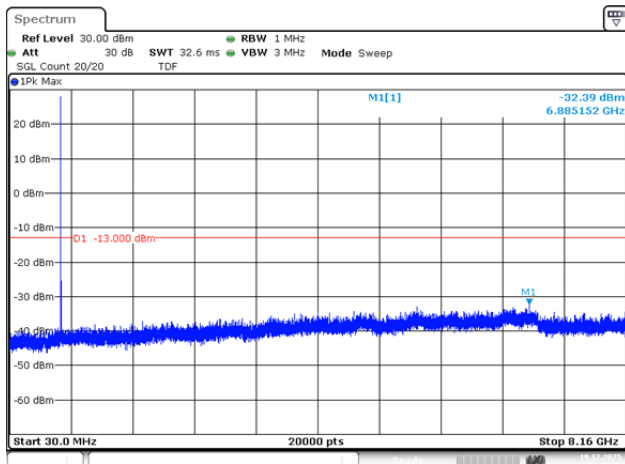


ProjectNo.:2507Z22634E-RF Tester:Braylon Ma  
Date: 19.DEC.2025 16:42:45

5MHz\_Middle\_QPSK\_1@0(30MHz~8.16GHz)

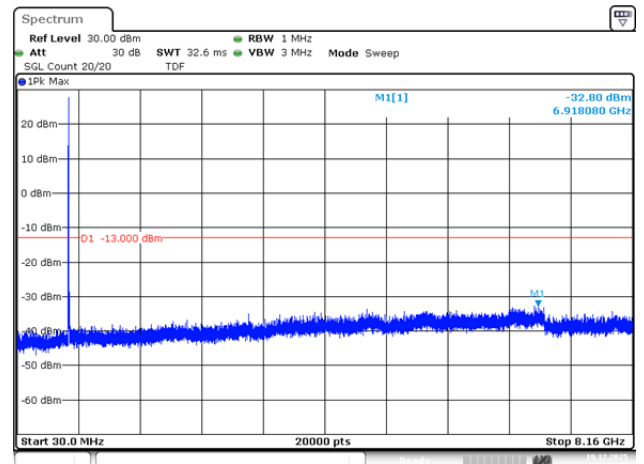


ProjectNo.:2507Z22634E-RF Tester:Braylon Ma  
Date: 19.DEC.2025 16:43:19

5MHz\_High\_QPSK\_1@0(30MHz~8.16GHz)

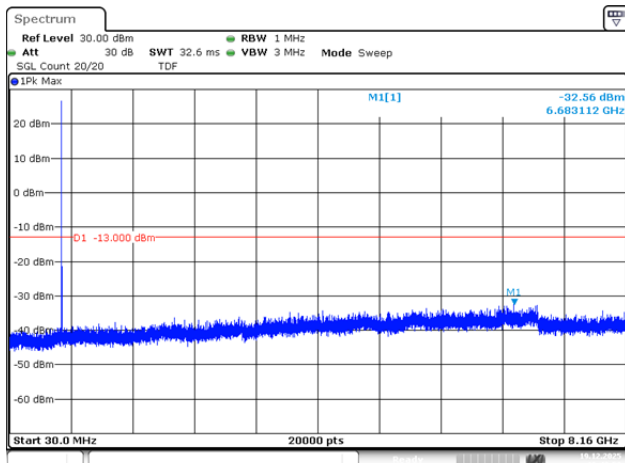


ProjectNo.:2507Z22634E-RF Tester:Braylon Ma  
Date: 19.DEC.2025 16:43:59

10MHz\_Low\_QPSK\_1@0(30MHz~8.16GHz)

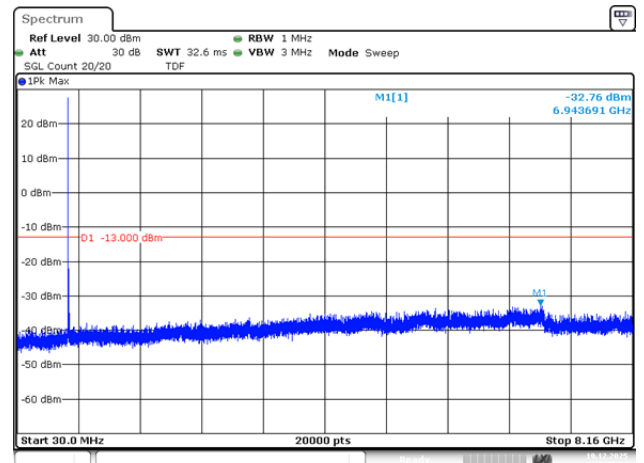


ProjectNo.:2507Z22634E-RF Tester:Braylon Ma  
Date: 19.DEC.2025 16:45:29

10MHz\_Middle\_QPSK\_1@0(30MHz~8.16GHz)

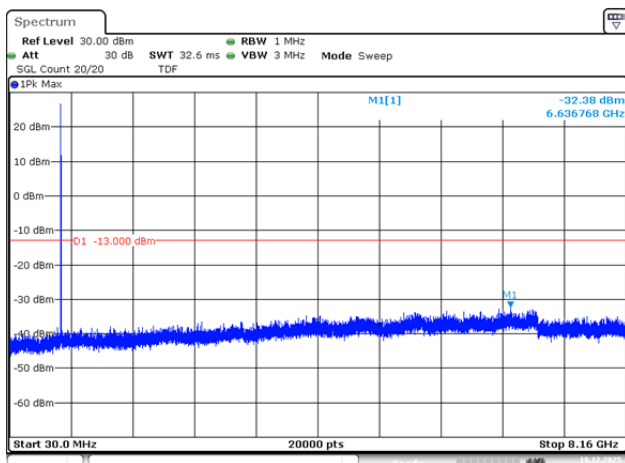

ProjectNo.:2507Z22634E-RF Tester:Braylon Ma  
Date: 19.DEC.2025 16:46:04

10MHz\_High\_QPSK\_1@0(30MHz~8.16GHz)

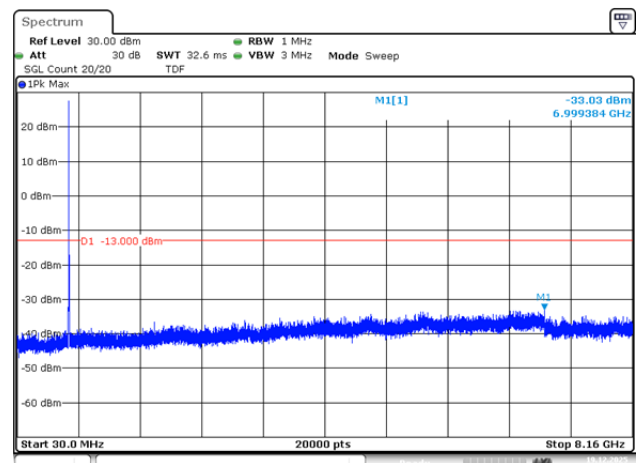


ProjectNo.:2507Z22634E-RF Tester:Braylon Ma  
Date: 19.DEC.2025 16:46:39


## LTE Band 13, Normal

## 1RB was the worst case


5MHz\_Low\_QPSK\_1@0(30MHz~8.87GHz)

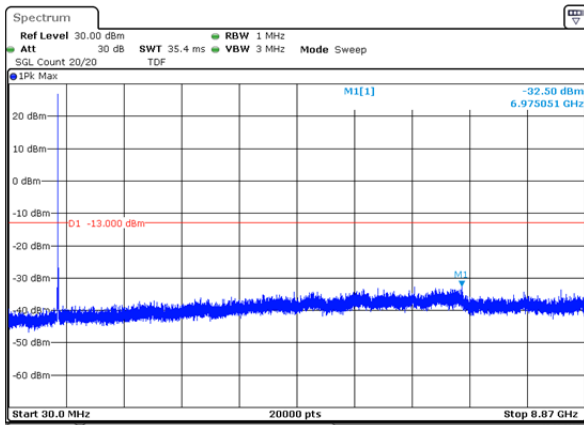ProjectNo.: 2507Z22634E-RF Testert:Braylon Ma  
Date: 19,DEC,2025 16:47:30


5MHz\_Low\_QPSK\_1@0(763MHz~775MHz)

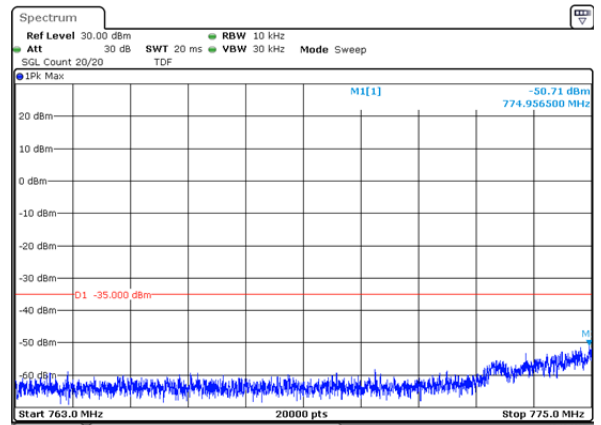ProjectNo.: 2507Z22634E-RF Testert:Braylon Ma  
Date: 19,DEC,2025 16:47:43


5MHz\_Low\_QPSK\_1@0(793MHz~806MHz)

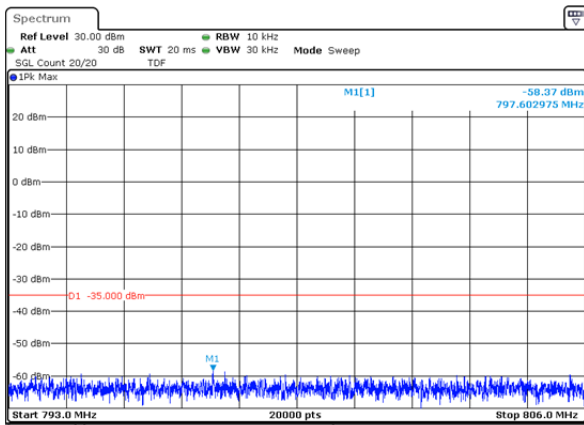ProjectNo.: 2507Z22634E-RF Testert:Braylon Ma  
Date: 19,DEC,2025 16:47:57


5MHz\_Low\_QPSK\_1@0(1559MHz~1610MHz)

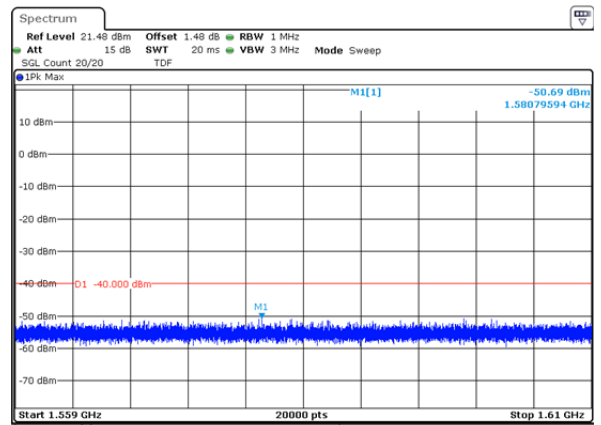ProjectNo.: 2507Z22634E-RF Testert:Braylon Ma  
Date: 22,DEC,2025 10:18:20


5MHz\_High\_QPSK\_1@0(30MHz~8.87GHz)

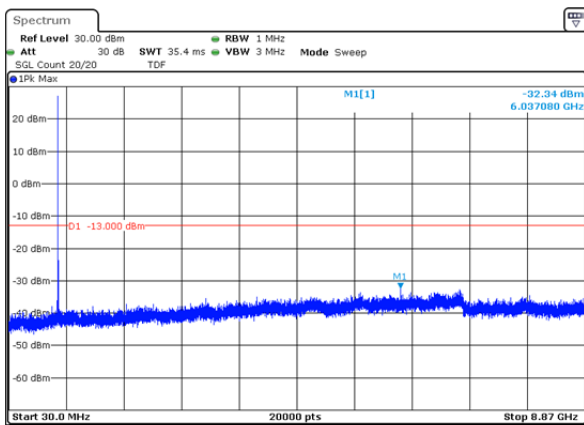ProjectNo.: 2507Z22634E-RF Testert:Braylon Ma  
Date: 19,DEC,2025 16:49:22

5MHz\_High\_QPSK\_1@0(763MHz~775MHz)

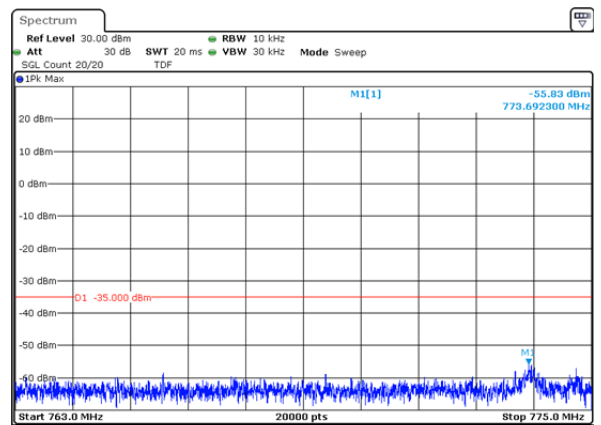
ProjectNo.: 2507Z22634E-RF Testert:Braylon Ma  
Date: 19,DEC,2025 16:49:35

5MHz\_High\_QPSK\_1@0(793MHz~806MHz)

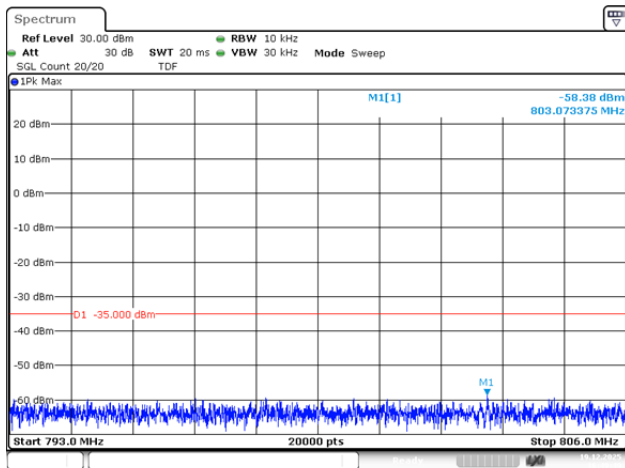


ProjectNo.:2507Z22634E-RF Tester:Braylon Ma  
Date: 19.DEC.2025 16:49:48

5MHz\_High\_QPSK\_1@0(1559MHz~1610MHz)

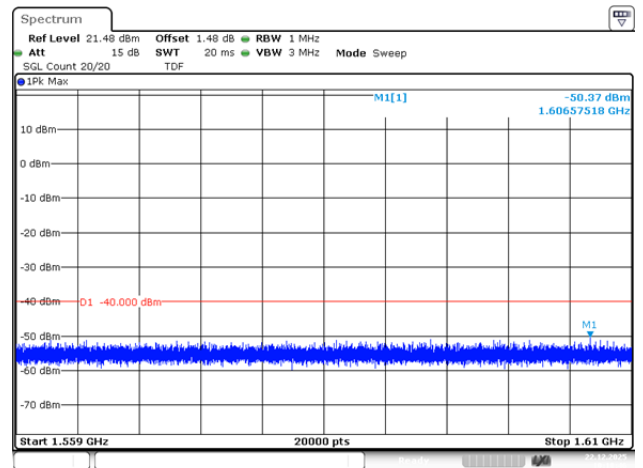


ProjectNo.:2507Z22634E-RF Tester:Braylon Ma  
Date: 22.DEC.2025 10:18:46

10MHz\_Middle\_QPSK\_1@0(30MHz~8.87GHz)

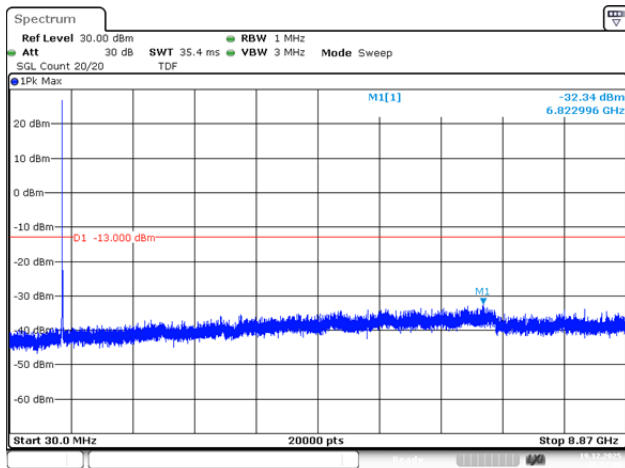


ProjectNo.:2507Z22634E-RF Tester:Braylon Ma  
Date: 19.DEC.2025 16:52:06

10MHz\_Middle\_QPSK\_1@0(763MHz~775MHz)

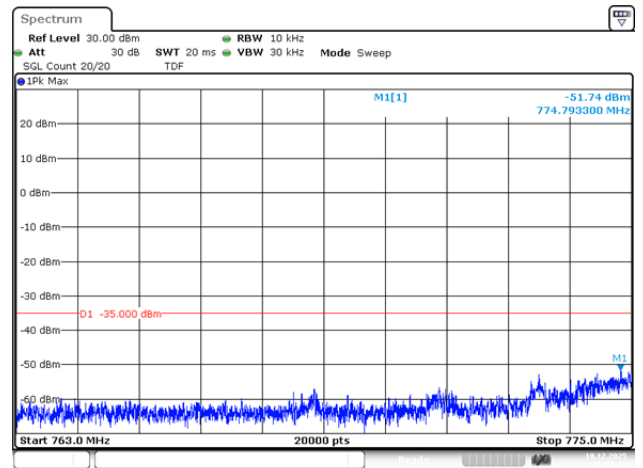


ProjectNo.:2507Z22634E-RF Tester:Braylon Ma  
Date: 19.DEC.2025 16:52:19

10MHz\_Middle\_QPSK\_1@0(793MHz~806MHz)

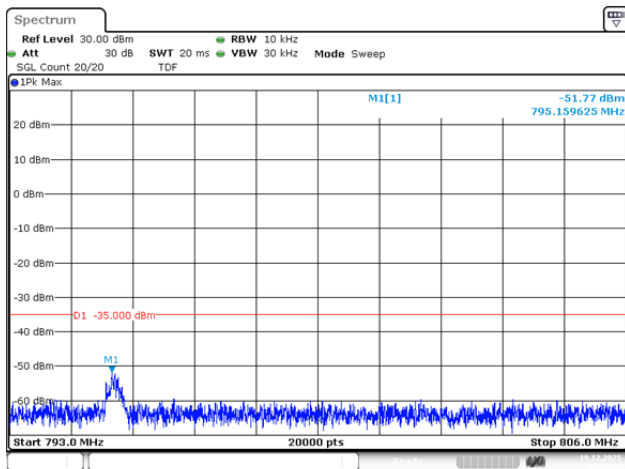

ProjectNo.:2507Z22634E-RF Tester:Braylon Ma  
Date: 19.DEC.2025 16:52:32

10MHz\_Middle\_QPSK\_1@0(1559MHz~1610MHz)

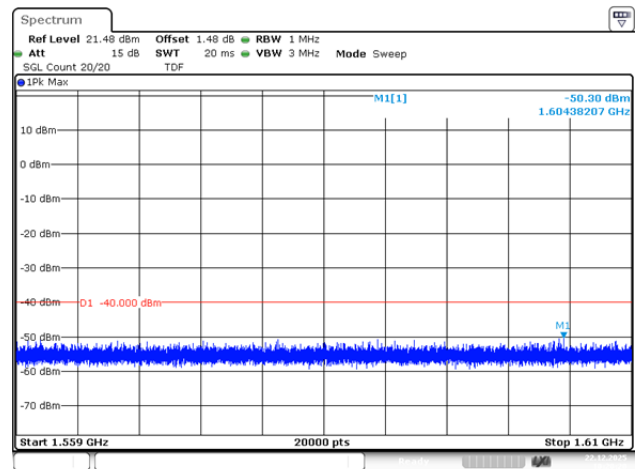


ProjectNo.:2507Z22634E-RF Tester:Braylon Ma  
Date: 22.DEC.2025 10:20:20

## LTE Band 66, Normal


## 1RB was the worst case

1.4MHz\_Low\_QPSK\_1@0(30MHz~18.8GHz)

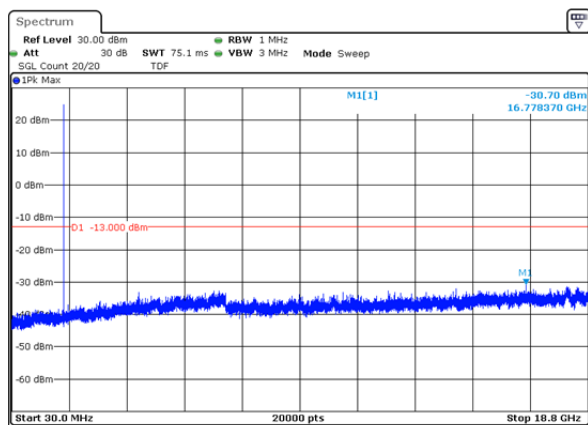


ProjectNo.: 2507Z22634E-RF Testert:Braylon Ma  
Date: 19,DEC,2025 17:01:33

1.4MHz\_Middle\_QPSK\_1@0(30MHz~18.8GHz)

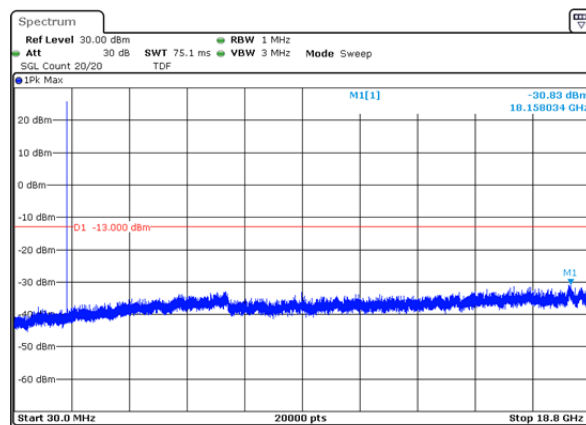


ProjectNo.: 2507Z22634E-RF Testert:Braylon Ma  
Date: 19,DEC,2025 17:02:16

1.4MHz\_High\_QPSK\_1@0(30MHz~18.8GHz)

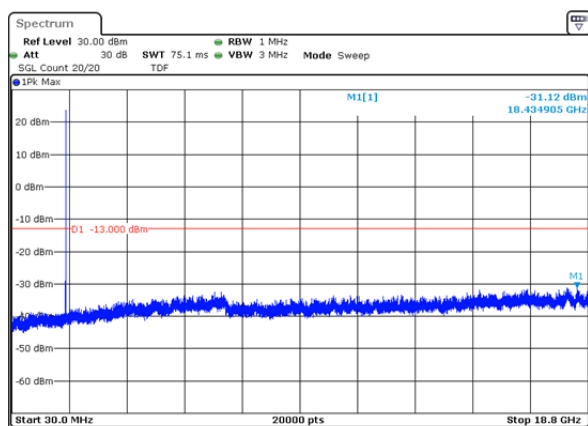


ProjectNo.: 2507Z22634E-RF Testert:Braylon Ma  
Date: 19,DEC,2025 17:02:58

3MHz\_Low\_QPSK\_1@0(30MHz~18.8GHz)

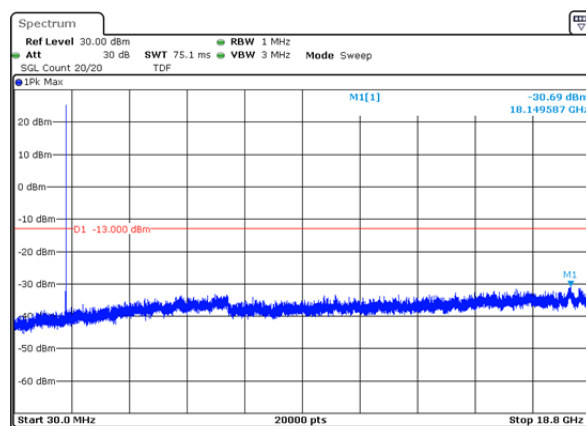


ProjectNo.: 2507Z22634E-RF Testert:Braylon Ma  
Date: 23,DEC,2025 11:22:34

3MHz\_Middle\_QPSK\_1@0(30MHz~18.8GHz)

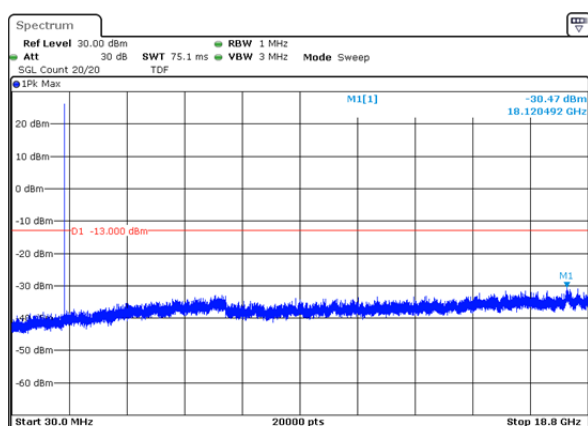


ProjectNo.: 2507Z22634E-RF Testert:Braylon Ma  
Date: 19,DEC,2025 17:04:41

3MHz\_High\_QPSK\_1@0(30MHz~18.8GHz)

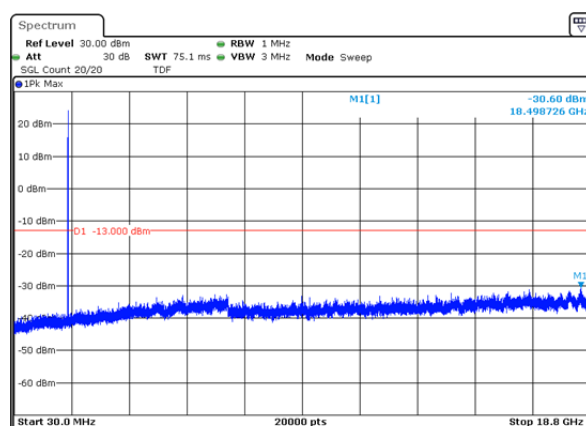


ProjectNo.: 2507Z22634E-RF Testert:Braylon Ma  
Date: 19,DEC,2025 17:05:24

5MHz\_Low\_QPSK\_1@0(30MHz~18.8GHz)

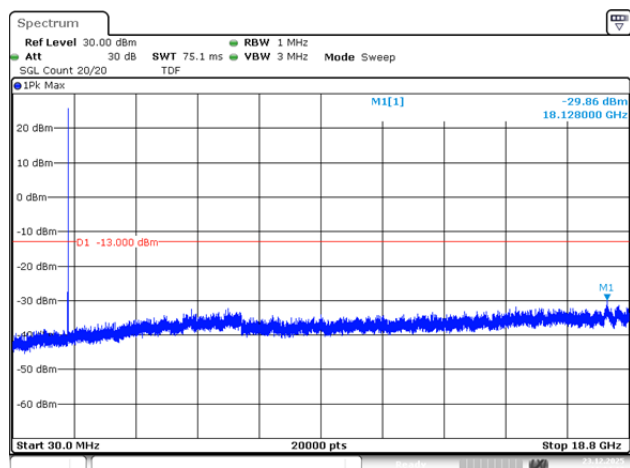


ProjectNo.: 2507Z22634E-RF Tester: Braylon Ma  
Date: 23.DEC.2025 11:24:12

5MHz\_Middle\_QPSK\_1@0(30MHz~18.8GHz)

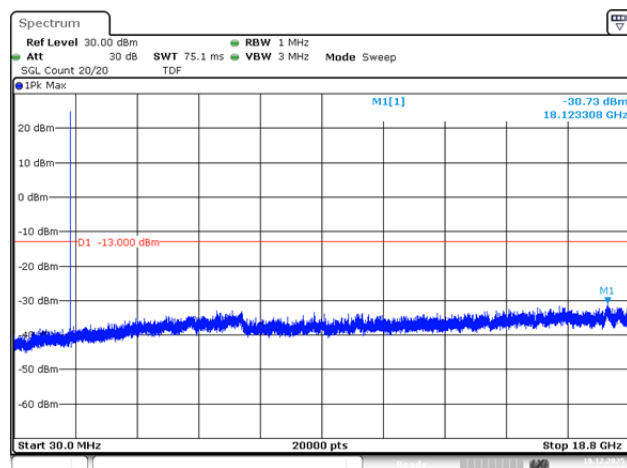


ProjectNo.: 2507Z22634E-RF Tester: Braylon Ma  
Date: 19.DEC.2025 17:07:09

5MHz\_High\_QPSK\_1@0(30MHz~18.8GHz)

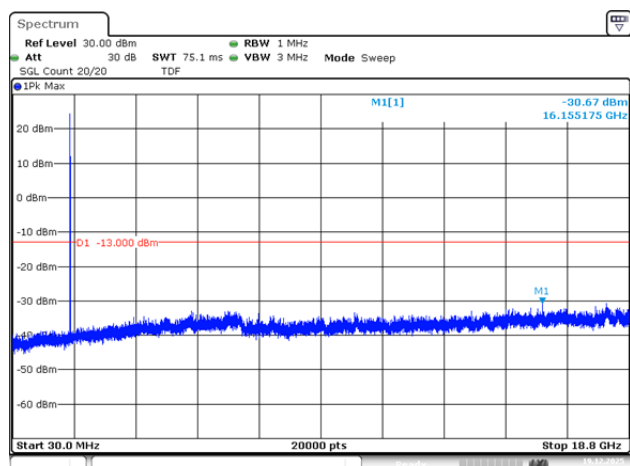


ProjectNo.: 2507Z22634E-RF Tester: Braylon Ma  
Date: 19.DEC.2025 17:07:51

10MHz\_Low\_QPSK\_1@0(30MHz~18.8GHz)

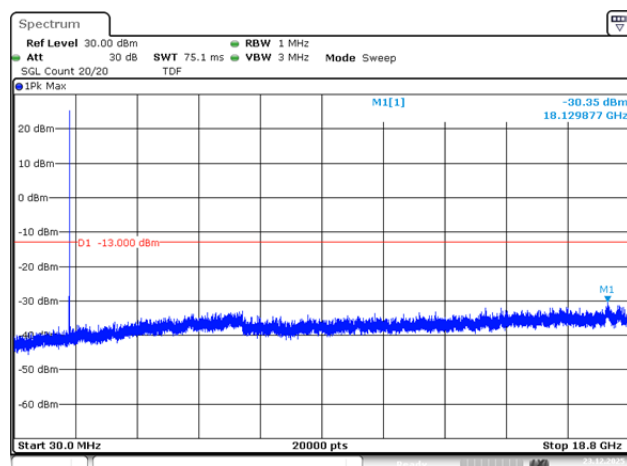


ProjectNo.: 2507Z22634E-RF Tester: Braylon Ma  
Date: 23.DEC.2025 11:25:54

10MHz\_Middle\_QPSK\_1@0(30MHz~18.8GHz)

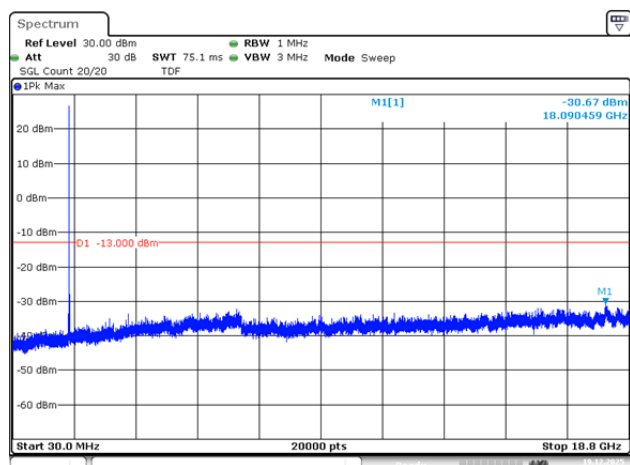


ProjectNo.: 2507Z22634E-RF Tester: Braylon Ma  
Date: 19.DEC.2025 17:09:34

10MHz\_High\_QPSK\_1@0(30MHz~18.8GHz)

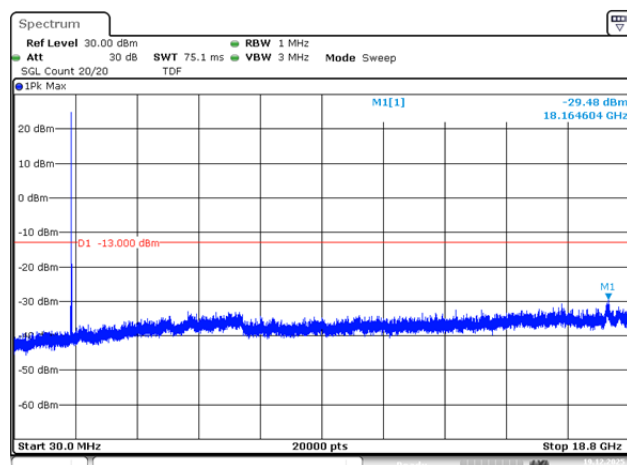


ProjectNo.: 2507Z22634E-RF Tester: Braylon Ma  
Date: 19.DEC.2025 17:10:16

15MHz\_Low\_QPSK\_1@0(30MHz~18.8GHz)

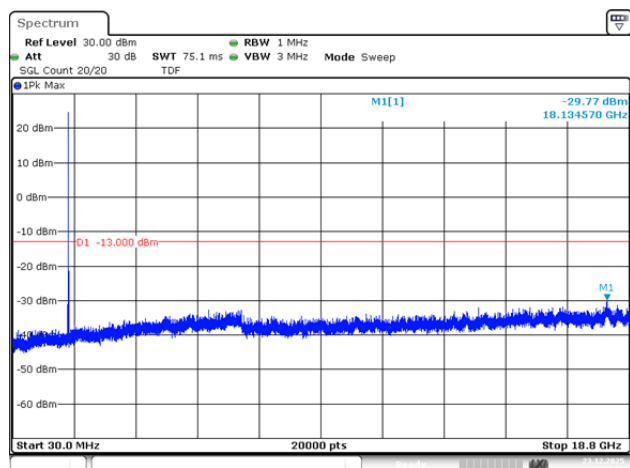


ProjectNo.: 2507Z22634E-RF Tester:Braylon Ma  
Date: 23.DEC.2025 11:26:54

15MHz\_Middle\_QPSK\_1@0(30MHz~18.8GHz)

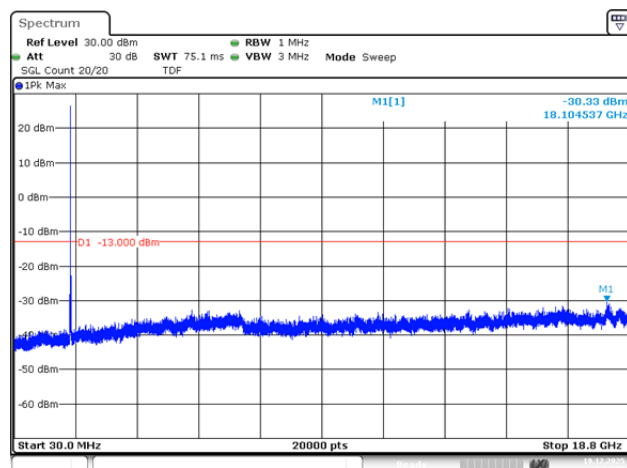


ProjectNo.: 2507Z22634E-RF Tester:Braylon Ma  
Date: 19.DEC.2025 17:11:59

15MHz\_High\_QPSK\_1@0(30MHz~18.8GHz)

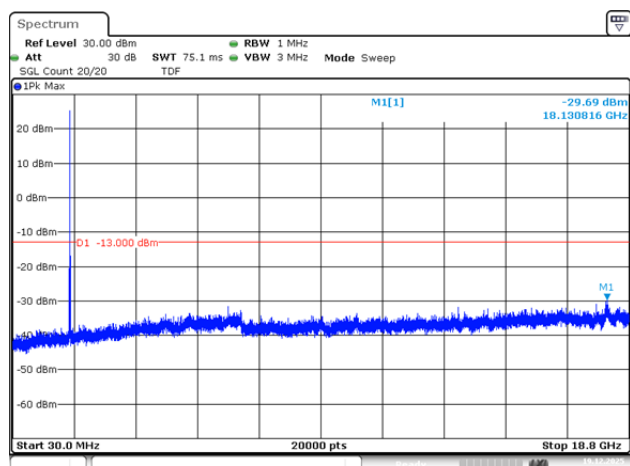


ProjectNo.: 2507Z22634E-RF Tester:Braylon Ma  
Date: 19.DEC.2025 17:12:41

20MHz\_Low\_QPSK\_1@0(30MHz~18.8GHz)

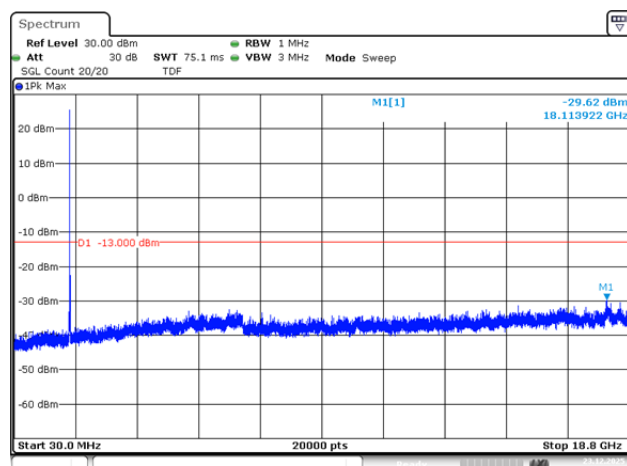


ProjectNo.: 2507Z22634E-RF Tester:Braylon Ma  
Date: 23.DEC.2025 11:27:50

20MHz\_Middle\_QPSK\_1@0(30MHz~18.8GHz)

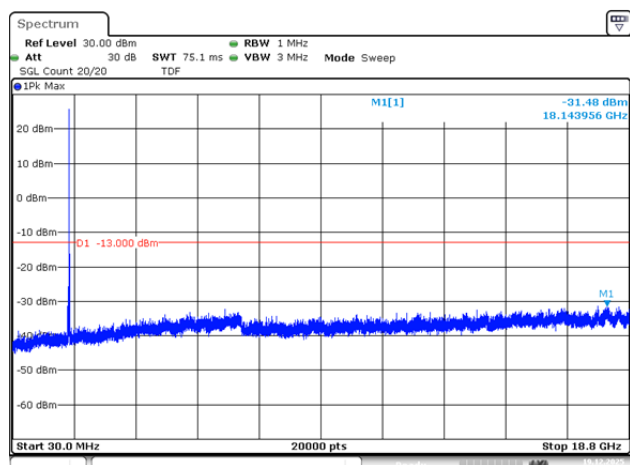

ProjectNo.: 2507Z22634E-RF Tester:Braylon Ma  
Date: 19.DEC.2025 17:14:23

20MHz\_High\_QPSK\_1@0(30MHz~18.8GHz)

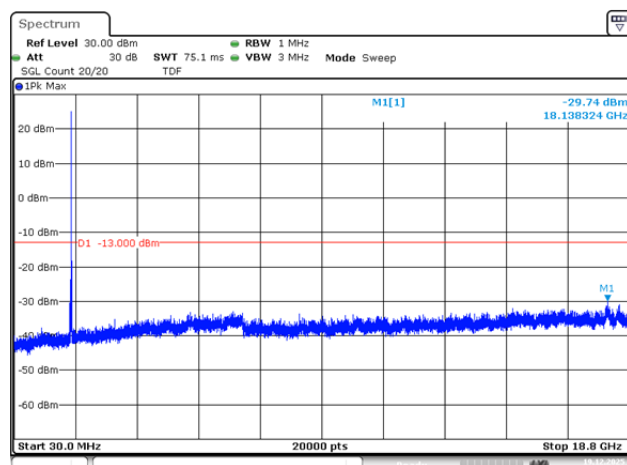


ProjectNo.: 2507Z22634E-RF Tester:Braylon Ma  
Date: 19.DEC.2025 17:15:06

## LTE Band 71, Normal


## 1RB was the worst case

5MHz\_Low\_QPSK\_1@0(30MHz~7.98GHz)

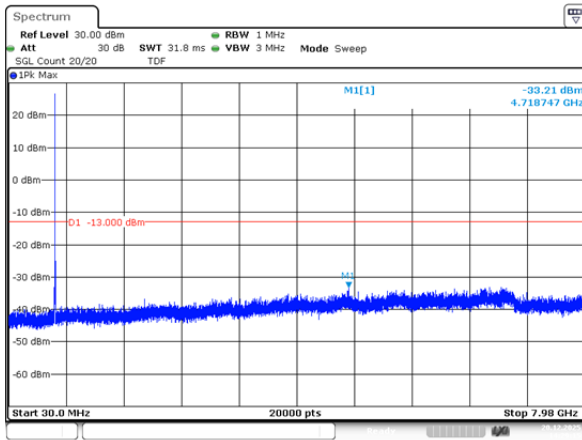


ProjectNo.: 2507Z22634E-RF Testset: Baylon Ma  
Date: 20 DEC, 2025 14:29:15

5MHz\_Middle\_QPSK\_1@0(30MHz~7.98GHz)

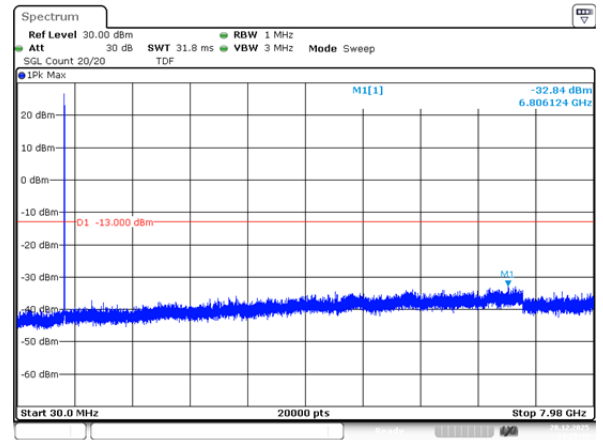


ProjectNo.: 2507Z22634E-RF Testset: Baylon Ma  
Date: 20 DEC, 2025 14:29:48

5MHz\_High\_QPSK\_1@0(30MHz~7.98GHz)

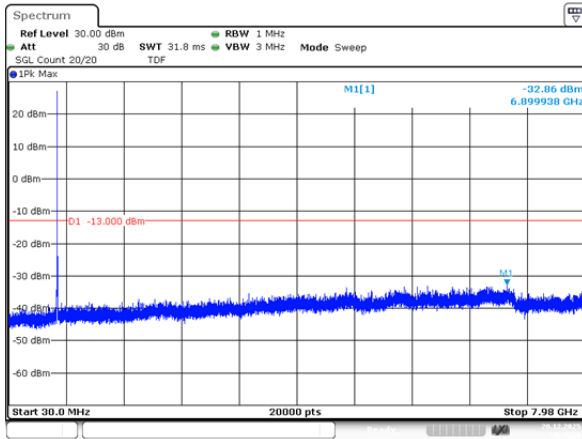


ProjectNo.: 2507Z22634E-RF Testset: Baylon Ma  
Date: 20 DEC, 2025 14:30:20

10MHz\_Low\_QPSK\_1@0(30MHz~7.98GHz)

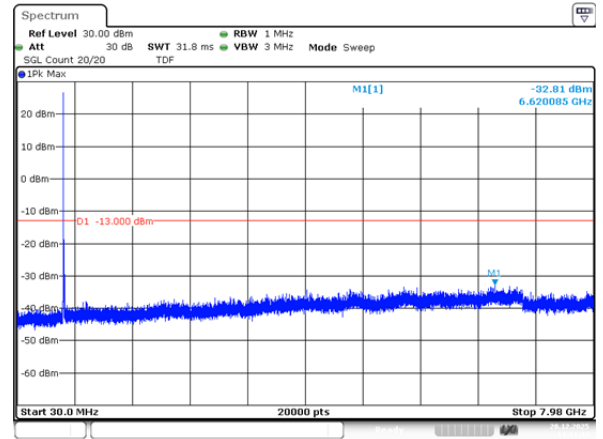


ProjectNo.: 2507Z22634E-RF Testset: Baylon Ma  
Date: 20 DEC, 2025 14:31:44

10MHz\_Middle\_QPSK\_1@0(30MHz~7.98GHz)

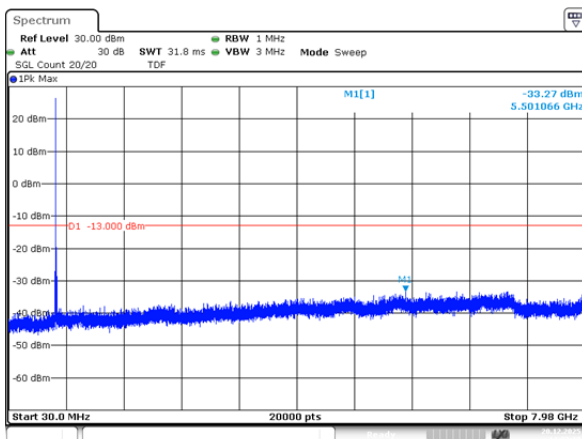

ProjectNo.: 2507Z22634E-RF Testset: Baylon Ma  
Date: 20 DEC, 2025 14:32:18

10MHz\_High\_QPSK\_1@0(30MHz~7.98GHz)

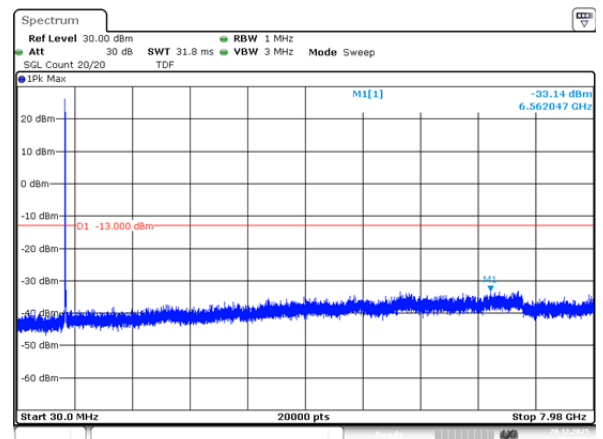

ProjectNo.: 2507Z22634E-RF Testset: Baylon Ma  
Date: 20 DEC, 2025 14:32:50