





Band2-3MHz-QPSK-19185-1RB#0-Range1:30~1000MHz

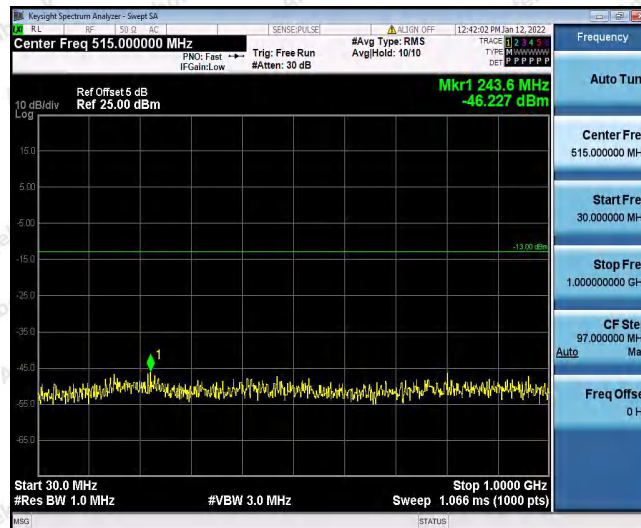

Band2-3MHz-QPSK-19185-1RB#0-Range2:1000~20000MHz

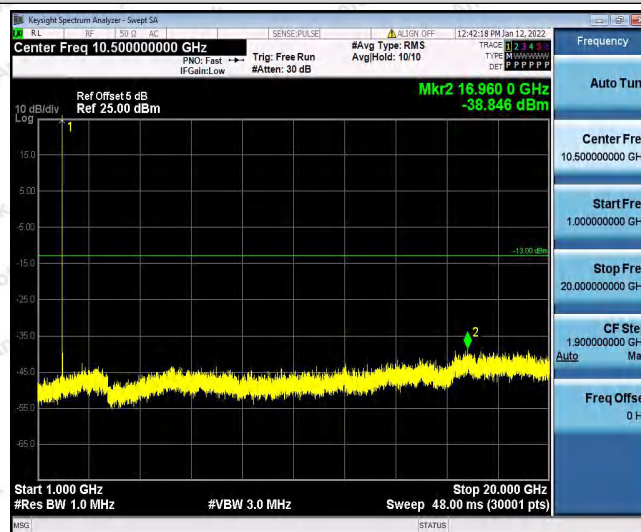

Band2-3MHz-16QAM-18615-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com

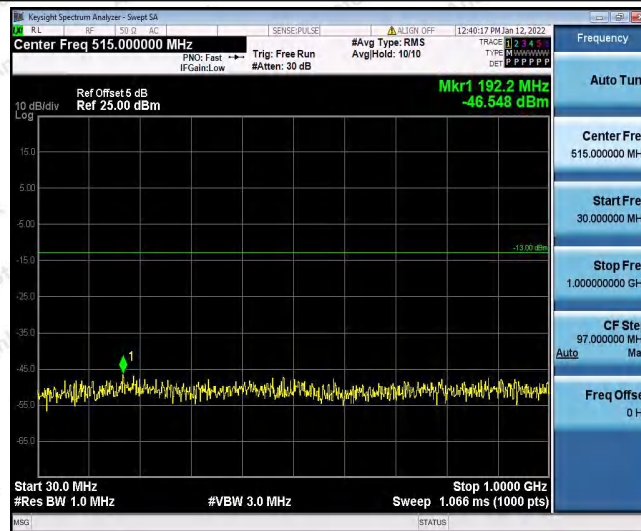

Band2-3MHz-16QAM-18615-1RB#0-Range2:1000~20000MHz

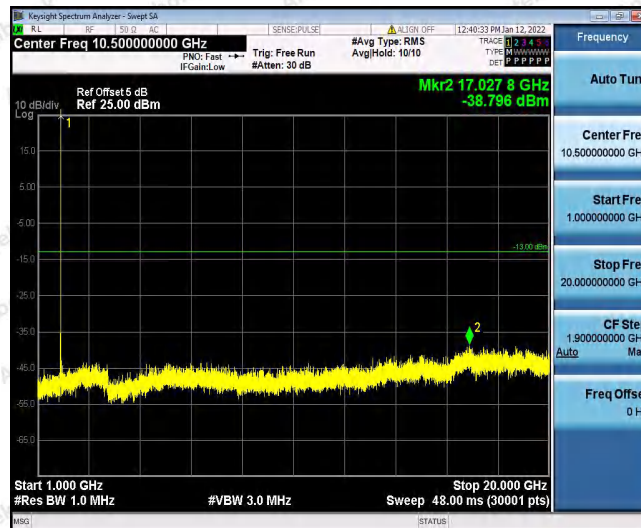

Band2-3MHz-16QAM-18900-1RB#0-Range1:30~1000MHz

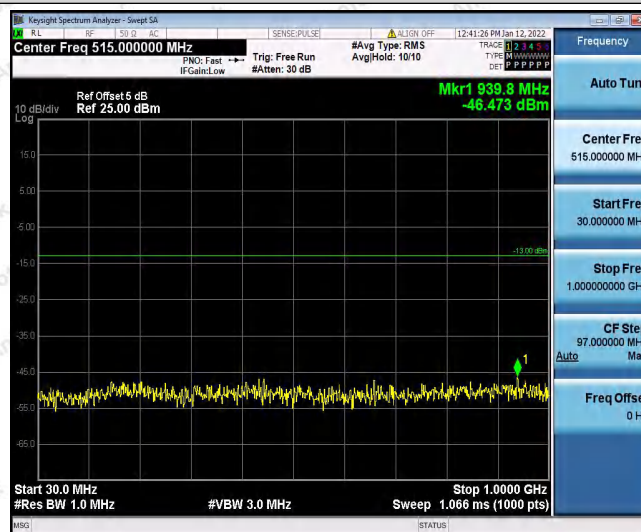

Band2-3MHz-16QAM-18900-1RB#0-Range2:1000~20000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com

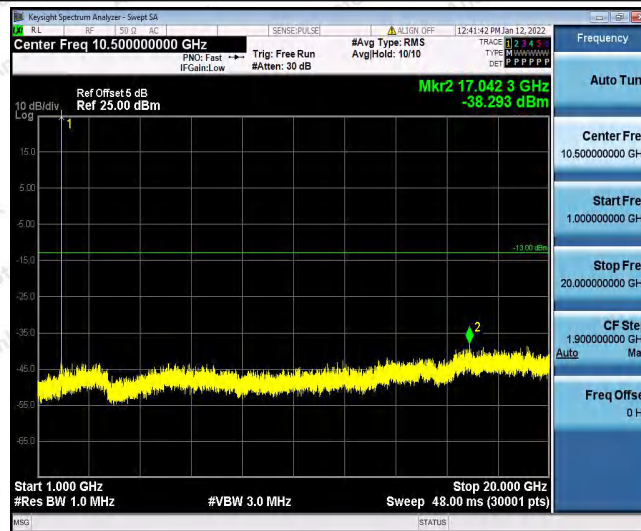

Band2-3MHz-16QAM-19185-1RB#0-Range1:30~1000MHz

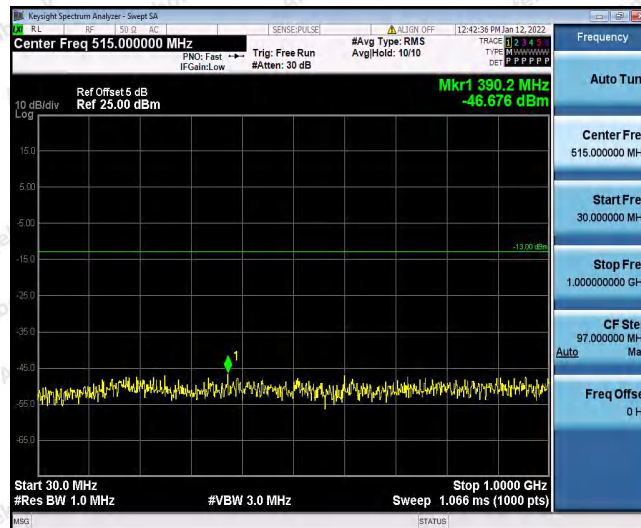

Band2-3MHz-16QAM-19185-1RB#0-Range2:1000~20000MHz

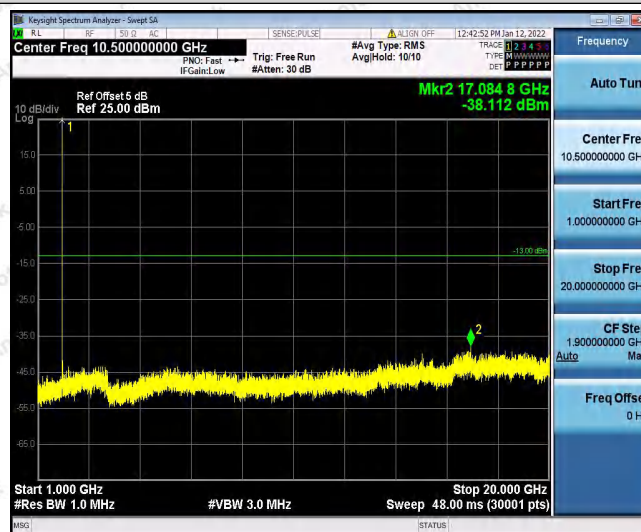

Band2-5MHz-QPSK-18625-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com

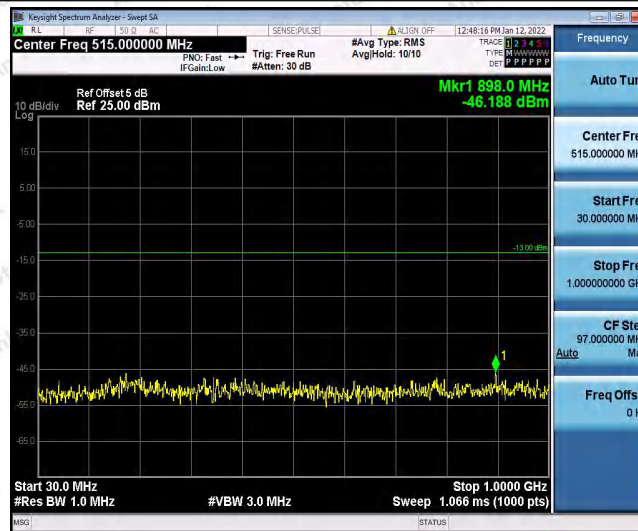

Band2-5MHz-QPSK-18625-1RB#0-Range2:1000~20000MHz

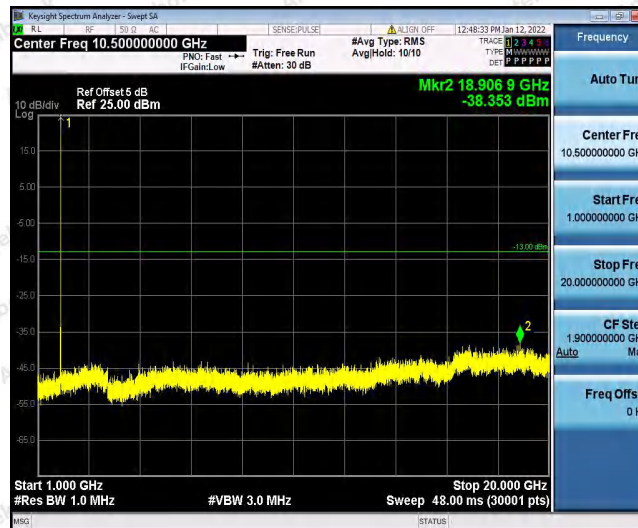

Band2-5MHz-QPSK-18900-1RB#0-Range1:30~1000MHz

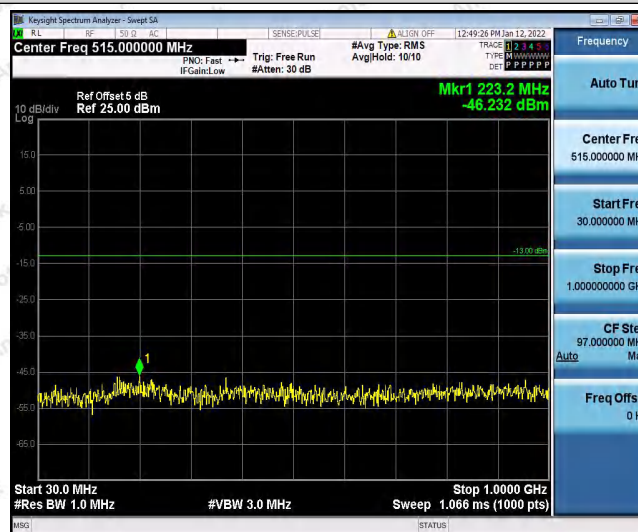

Band2-5MHz-QPSK-18900-1RB#0-Range2:1000~20000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com

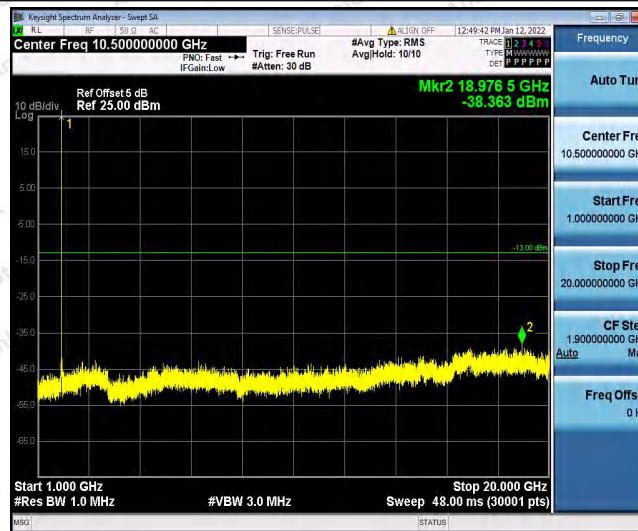

Band2-5MHz-QPSK-19175-1RB#0-Range1:30~1000MHz

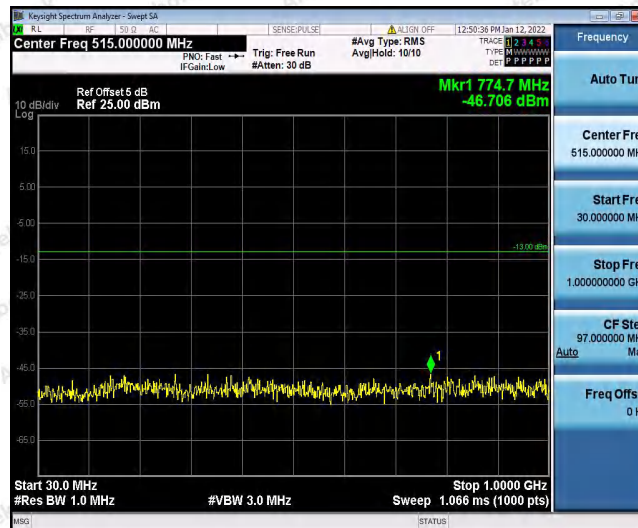

Band2-5MHz-QPSK-19175-1RB#0-Range2:1000~20000MHz



Band2-5MHz-16QAM-18625-1RB#0-Range1:30~1000MHz

Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline


400-003-0500
www.anbotek.com

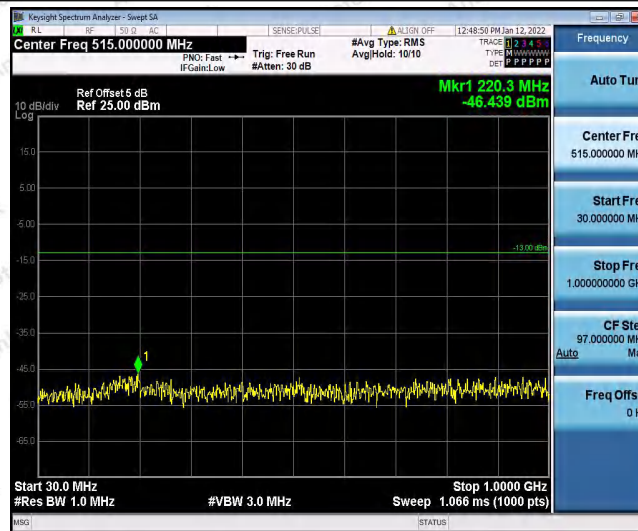

Band2-5MHz-16QAM-18625-1RB#0-Range2:1000~20000MHz

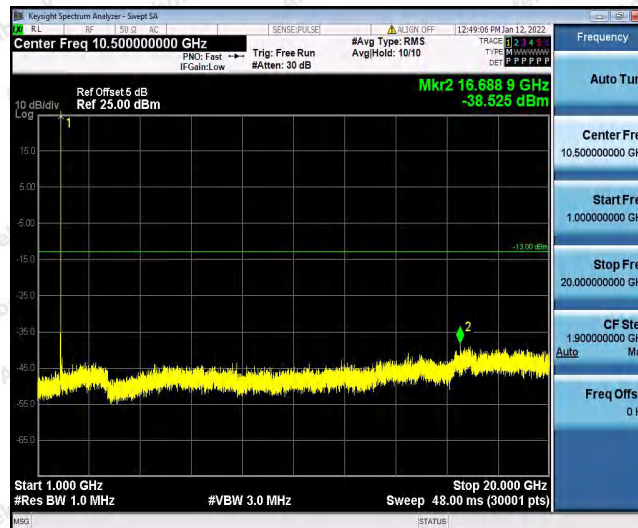

Band2-5MHz-16QAM-18900-1RB#0-Range1:30~1000MHz

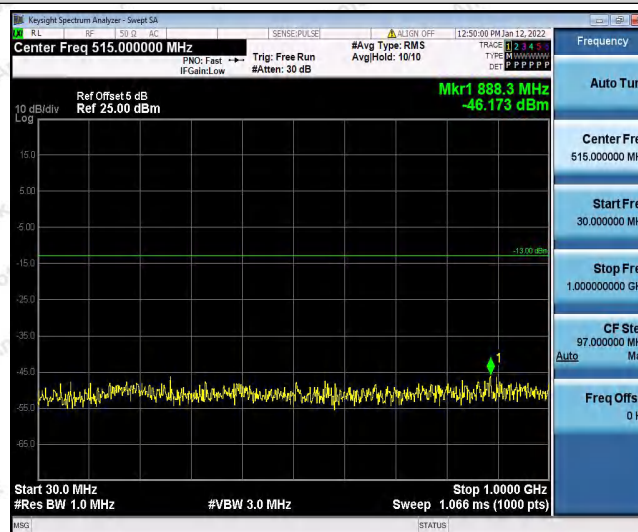

Band2-5MHz-16QAM-18900-1RB#0-Range2:1000~20000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com

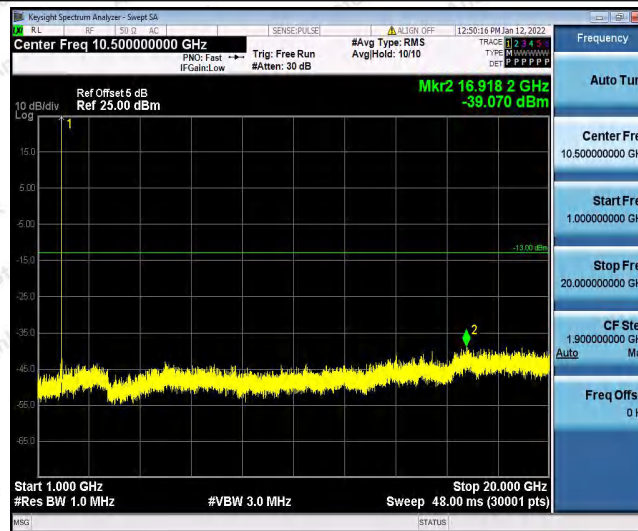

Band2-5MHz-16QAM-19175-1RB#0-Range1:30~1000MHz

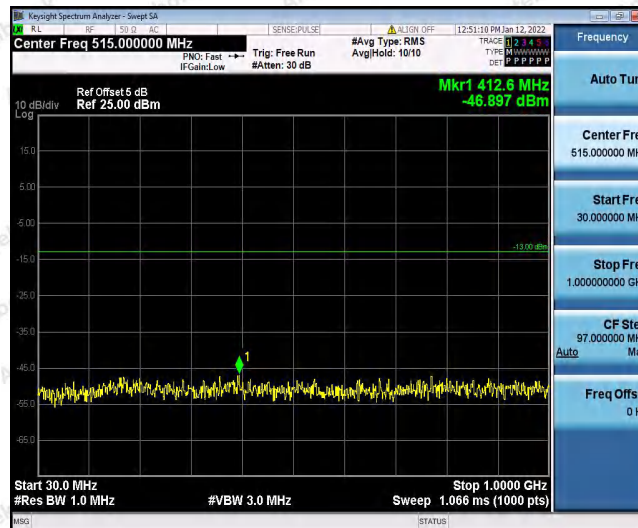

Band2-5MHz-16QAM-19175-1RB#0-Range2:1000~20000MHz




Band2-10MHz-QPSK-18650-1RB#0-Range1:30~1000MHz

Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

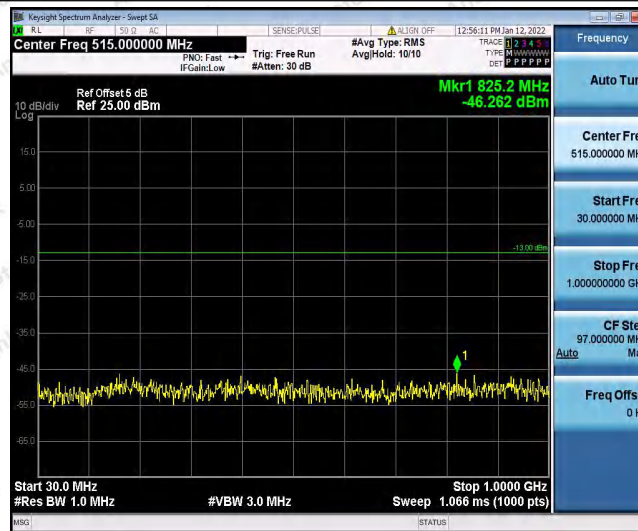

Band2-10MHz-QPSK-18650-1RB#0-Range2:1000~20000MHz

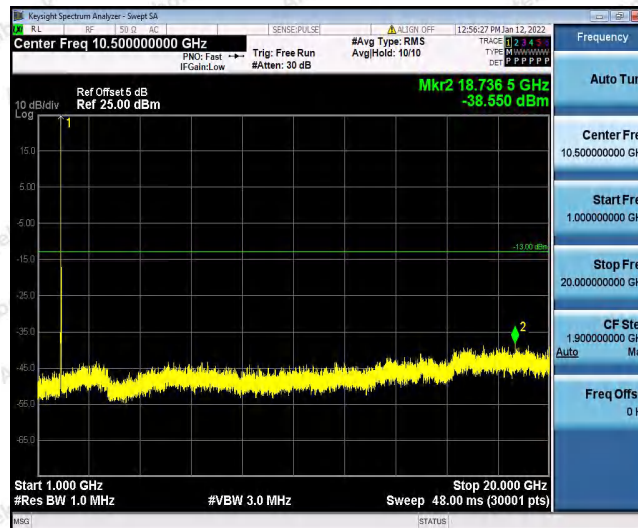

Band2-10MHz-QPSK-18900-1RB#0-Range1:30~1000MHz

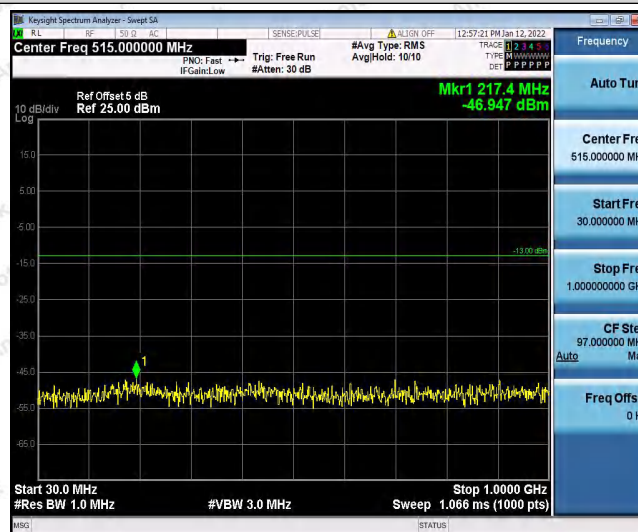

Band2-10MHz-QPSK-18900-1RB#0-Range2:1000~20000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com



Band2-10MHz-QPSK-19150-1RB#0-Range1:30~1000MHz

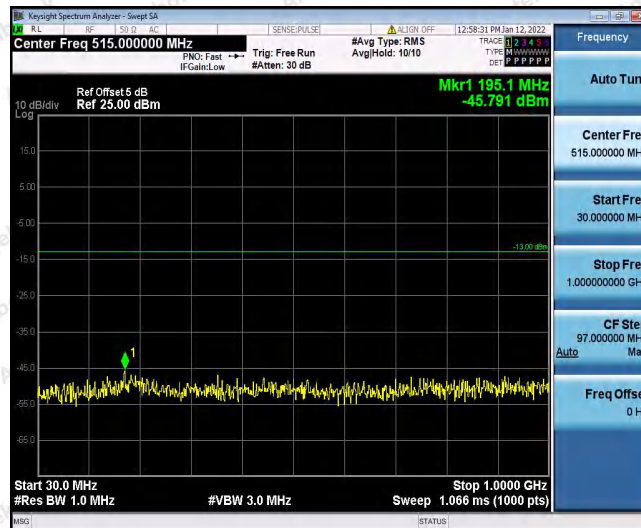

Band2-10MHz-QPSK-19150-1RB#0-Range2:1000~20000MHz

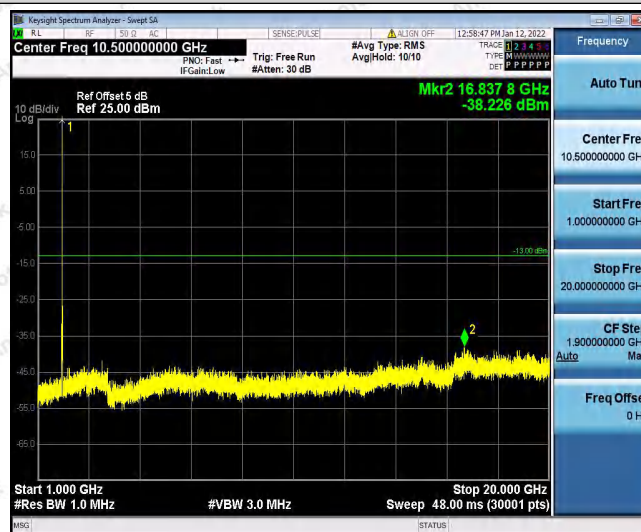

Band2-10MHz-16QAM-18650-1RB#0-Range1:30~1000MHz

Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline


400-003-0500
www.anbotek.com

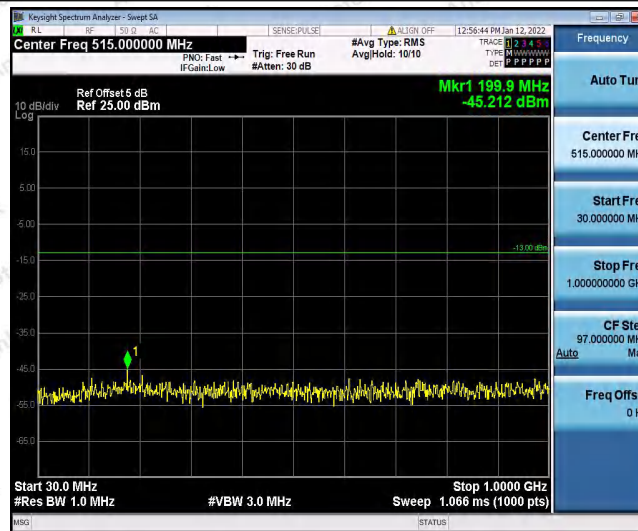

Band2-10MHz-16QAM-18650-1RB#0-Range2:1000~20000MHz

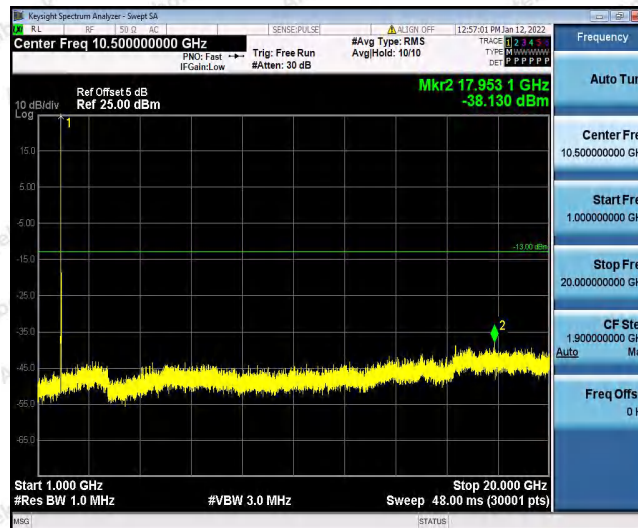

Band2-10MHz-16QAM-18900-1RB#0-Range1:30~1000MHz

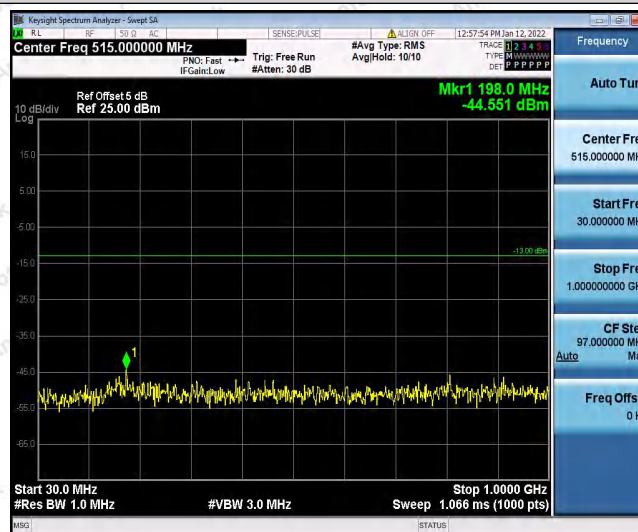

Band2-10MHz-16QAM-18900-1RB#0-Range2:1000~20000MHz

Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com


Hotline
400-003-0500
www.anbotek.com



Band2-10MHz-16QAM-19150-1RB#0-Range1:30~1000MHz

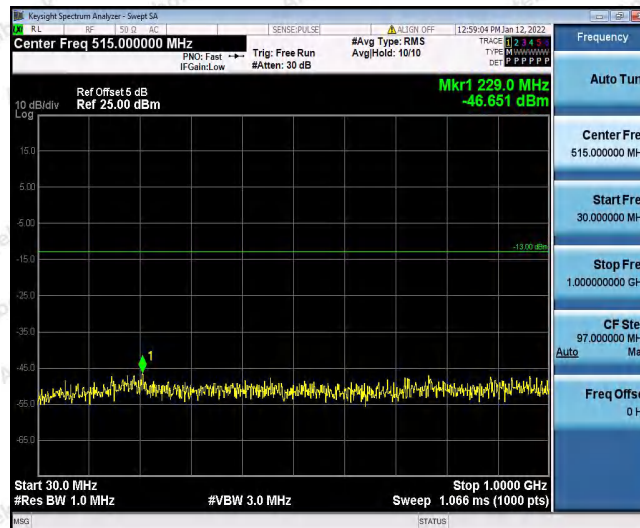

Band2-10MHz-16QAM-19150-1RB#0-Range2:1000~20000MHz

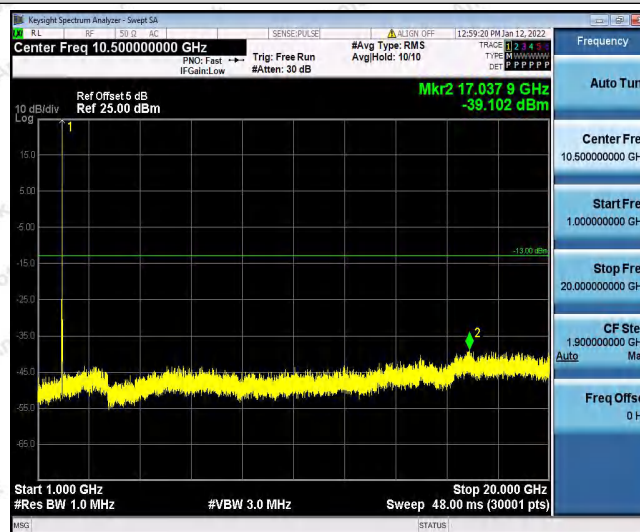

Band2-15MHz-QPSK-18675-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com

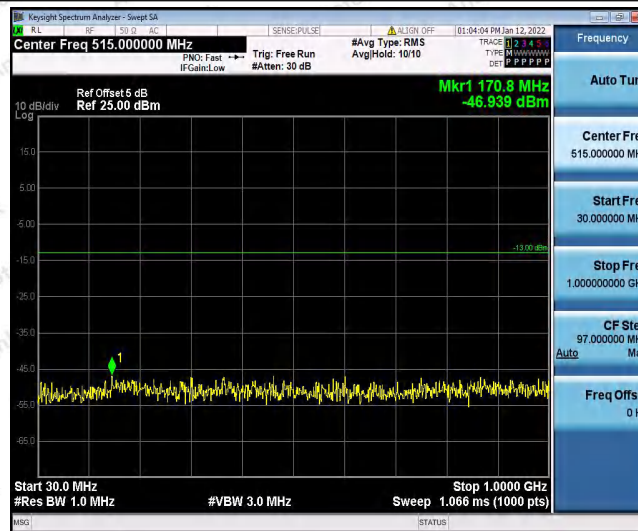

Band2-15MHz-QPSK-18675-1RB#0-Range2:1000~20000MHz

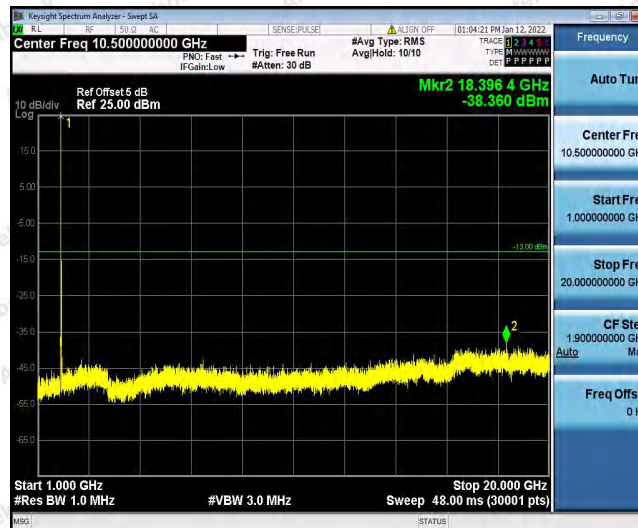

Band2-15MHz-QPSK-18900-1RB#0-Range1:30~1000MHz

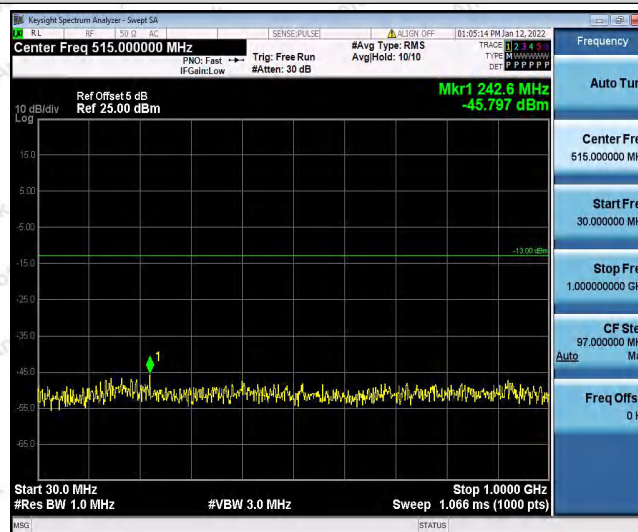

Band2-15MHz-QPSK-18900-1RB#0-Range2:1000~20000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com

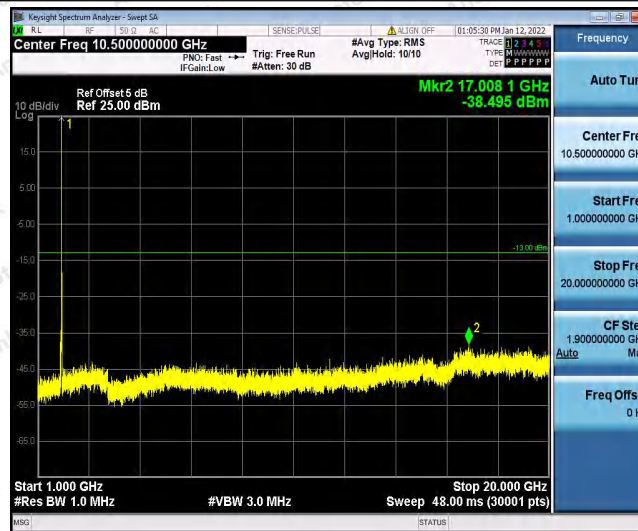

Band2-15MHz-QPSK-19125-1RB#0-Range1:30~1000MHz

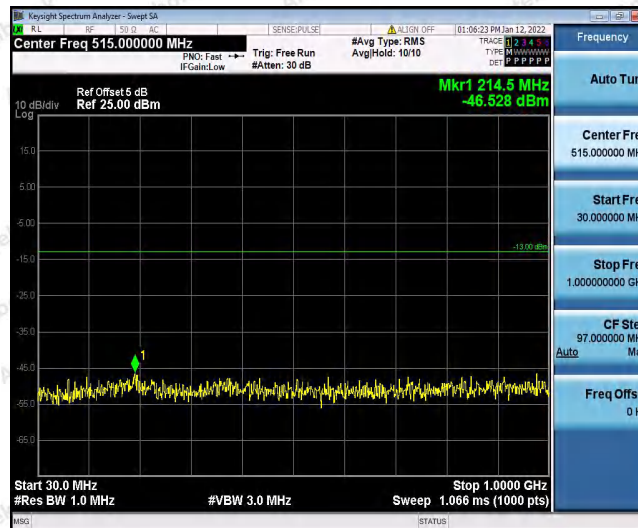

Band2-15MHz-QPSK-19125-1RB#0-Range2:1000~20000MHz

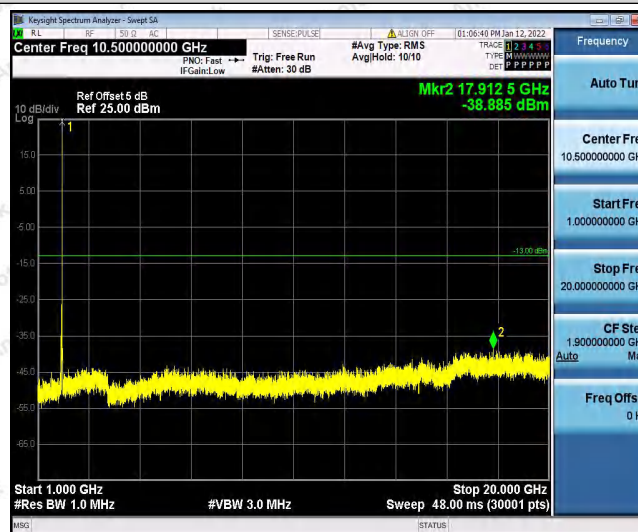

Band2-15MHz-16QAM-18675-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com

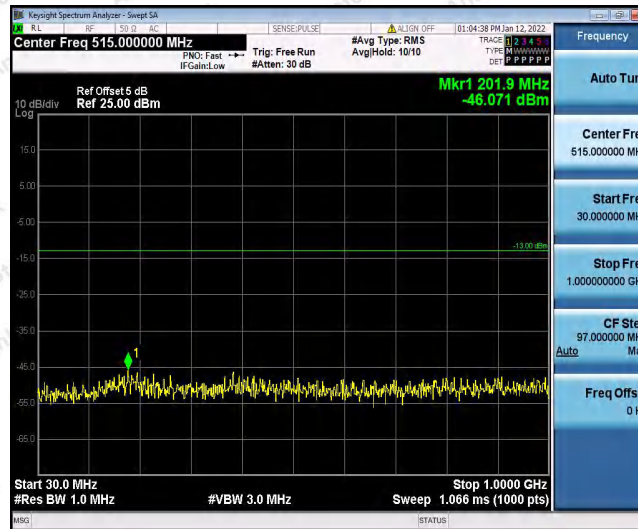

Band2-15MHz-16QAM-18675-1RB#0-Range2:1000~20000MHz

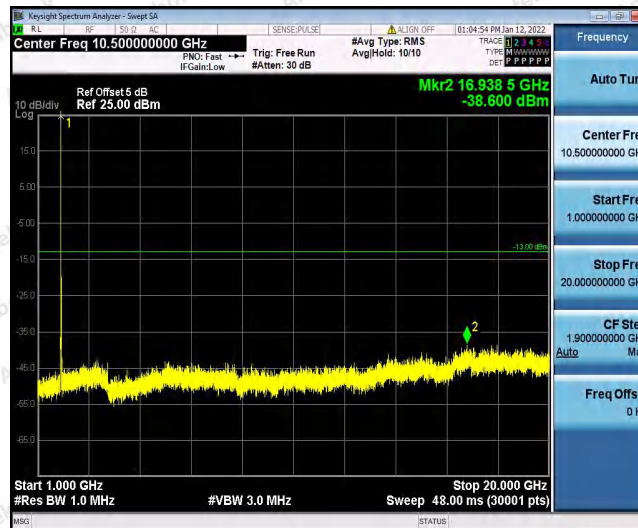

Band2-15MHz-16QAM-18900-1RB#0-Range1:30~1000MHz

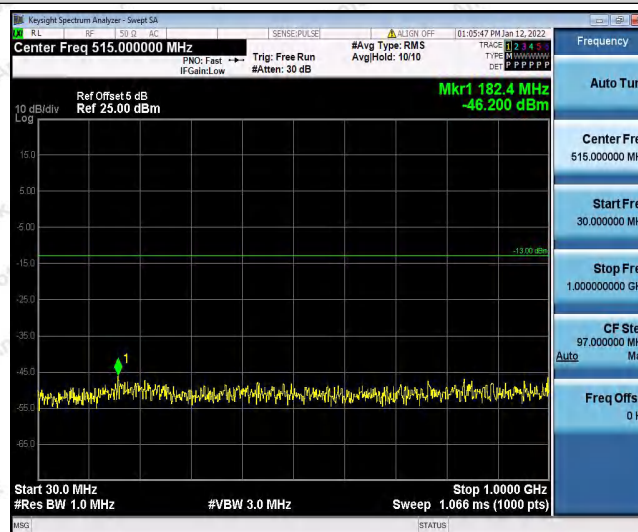


Band2-15MHz-16QAM-18900-1RB#0-Range2:1000~20000MHz

Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

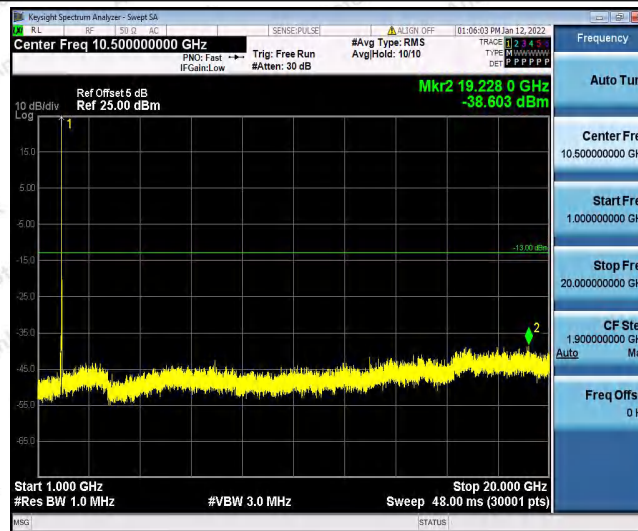

Band2-15MHz-16QAM-19125-1RB#0-Range1:30~1000MHz

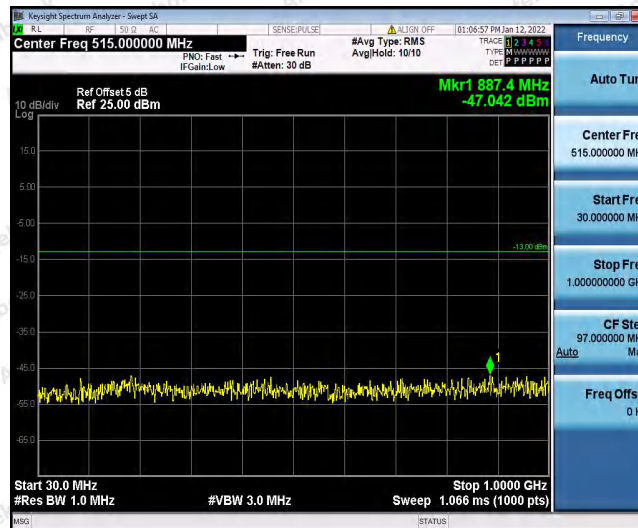

Band2-15MHz-16QAM-19125-1RB#0-Range2:1000~20000MHz

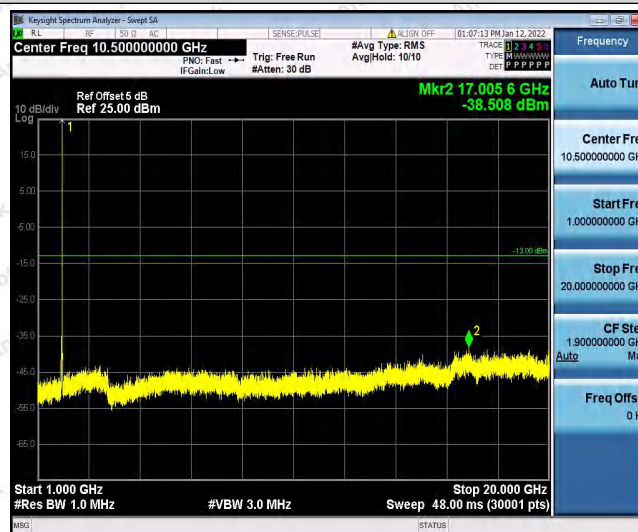

Band2-20MHz-QPSK-18700-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com

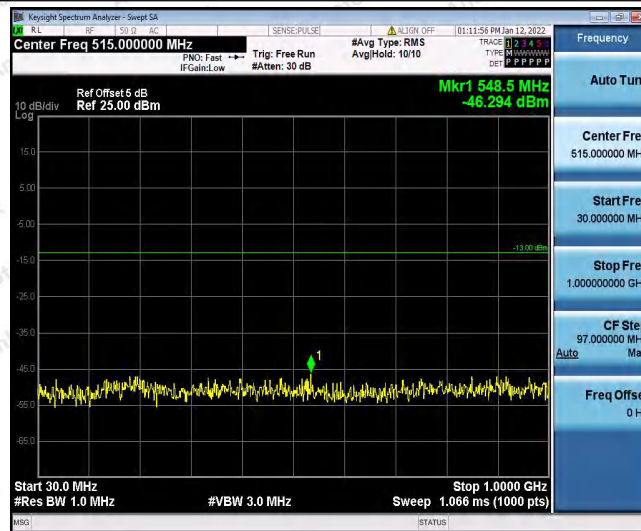

Band2-20MHz-QPSK-18700-1RB#0-Range2:1000~20000MHz



Band2-20MHz-QPSK-18900-1RB#0-Range1:30~1000MHz

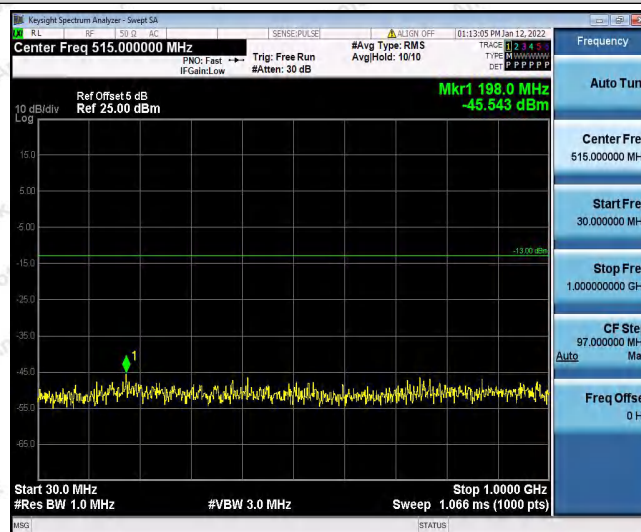

Band2-20MHz-QPSK-18900-1RB#0-Range2:1000~20000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com



Band2-20MHz-QPSK-19100-1RB#0-Range1:30~1000MHz

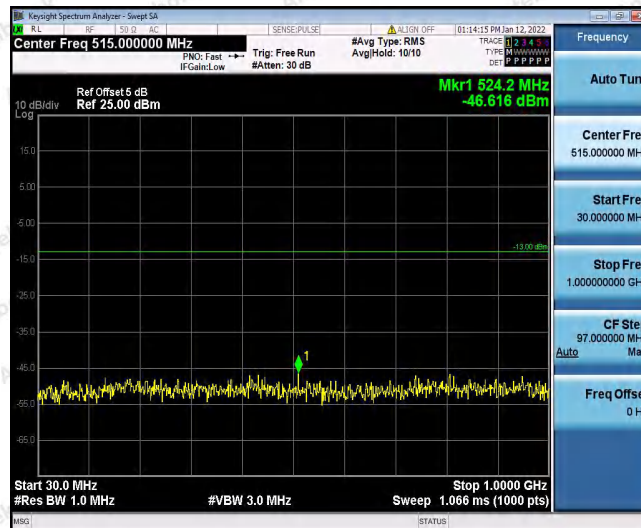

Band2-20MHz-QPSK-19100-1RB#0-Range2:1000~20000MHz



Band2-20MHz-16QAM-18700-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com

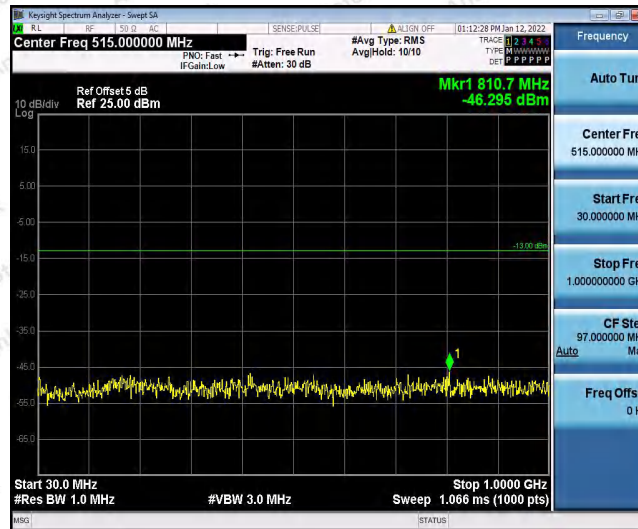

Band2-20MHz-16QAM-18700-1RB#0-Range2:1000~20000MHz

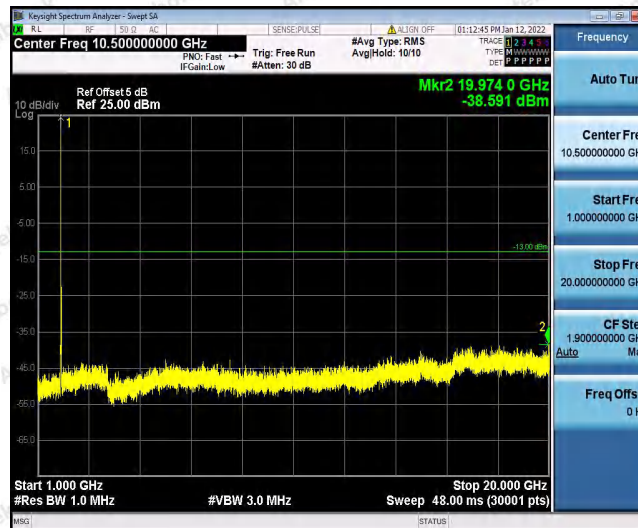

Band2-20MHz-16QAM-18900-1RB#0-Range1:30~1000MHz

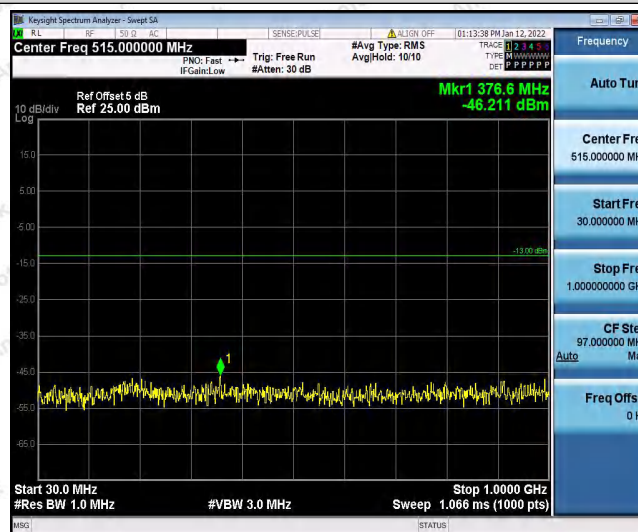

Band2-20MHz-16QAM-18900-1RB#0-Range2:1000~20000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com

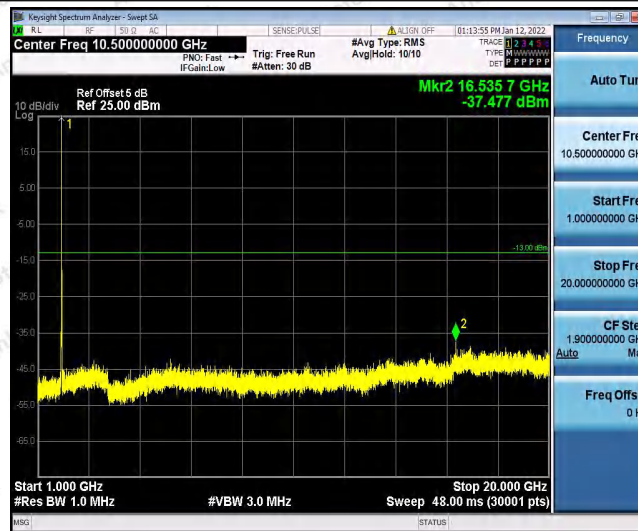

Band2-20MHz-16QAM-19100-1RB#0-Range1:30~1000MHz

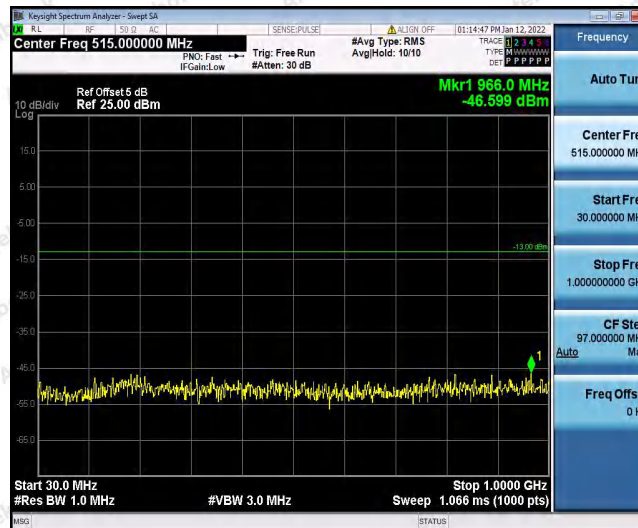

Band2-20MHz-16QAM-19100-1RB#0-Range2:1000~20000MHz



Appendix F: Frequency Stability VS Voltage

Test Result

Voltage										
Band	Bandwidth	Modulation	Channel	RB Configure	Voltage [Vdc]	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
Band2	1.4MHz	QPSK	18607	6RB#0	VL	NT	-4.95	-0.002675	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	VN	NT	-3.68	-0.001988	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	VH	NT	-7.78	-0.004204	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	VL	NT	-5.14	-0.002734	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	VN	NT	-7.71	-0.004101	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	VH	NT	-7.88	-0.004191	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	VL	NT	2.30	0.001205	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	VN	NT	6.59	0.003452	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	VH	NT	5.28	0.002765	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	VL	NT	-6.94	-0.003750	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	VN	NT	-7.90	-0.004269	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	VH	NT	-7.67	-0.004144	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	VL	NT	-9.03	-0.004803	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	VN	NT	-6.19	-0.003293	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	VH	NT	-10.00	-0.005319	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	VL	NT	-3.82	-0.002001	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	VN	NT	2.98	0.001561	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	VH	NT	2.53	0.001325	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	VL	NT	-5.98	-0.003230	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	VN	NT	-8.93	-0.004823	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	VH	NT	-7.51	-0.004056	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	VL	NT	-6.92	-0.003681	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	VN	NT	-7.62	-0.004053	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	VH	NT	-3.71	-0.001973	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	VL	NT	-5.52	-0.002892	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	VN	NT	-3.73	-0.001954	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	VH	NT	-2.26	-0.001184	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	VL	NT	-4.13	-0.002231	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	VN	NT	-5.85	-0.003160	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	VH	NT	-5.04	-0.002722	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	VL	NT	-6.57	-0.003495	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	VN	NT	-6.04	-0.003213	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	VH	NT	-8.47	-0.004505	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	VL	NT	4.38	0.002295	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500
www.anbotek.com

Band2	3MHz	16QAM	19185	15RB#0	VN	NT	4.25	0.002227	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	VH	NT	3.50	0.001834	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	VL	NT	-5.54	-0.002991	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	VN	NT	-7.10	-0.003833	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	VH	NT	-4.21	-0.002273	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	VL	NT	-8.45	-0.004495	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	VN	NT	-8.27	-0.004399	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	VH	NT	-5.44	-0.002894	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	VL	NT	2.39	0.001253	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	VN	NT	4.05	0.002123	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	VH	NT	3.16	0.001657	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	VL	NT	-6.15	-0.003320	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	VN	NT	-4.51	-0.002435	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	VH	NT	-7.90	-0.004265	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	VL	NT	-7.11	-0.003782	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	VN	NT	-9.18	-0.004883	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	VH	NT	-7.22	-0.003840	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	VL	NT	-3.48	-0.001824	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	VN	NT	-6.67	-0.003497	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	VH	NT	-2.57	-0.001347	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	VL	NT	-5.41	-0.002916	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	VN	NT	-6.24	-0.003364	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	VH	NT	-6.69	-0.003606	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	VL	NT	-5.79	-0.003080	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	VN	NT	-6.69	-0.003559	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	VH	NT	-6.51	-0.003463	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	VL	NT	-5.22	-0.002740	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	VN	NT	4.94	0.002593	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	VH	NT	-4.08	-0.002142	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	VL	NT	-6.62	-0.003569	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	VN	NT	-8.81	-0.004749	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	VH	NT	-8.98	-0.004841	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	VL	NT	-4.16	-0.002213	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	VN	NT	-7.47	-0.003973	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	VH	NT	-7.01	-0.003729	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	VL	NT	-4.09	-0.002147	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	VN	NT	6.29	0.003302	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	VH	NT	-4.49	-0.002357	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	VL	NT	-6.75	-0.003634	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	VN	NT	-7.81	-0.004205	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	VH	NT	-5.61	-0.003020	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com

 Hotline
 400-003-0500
www.anbotek.com

Band2	15MHz	QPSK	18900	75RB#0	VL	NT	-4.52	-0.002404	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	VN	NT	-6.54	-0.003479	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	VH	NT	-5.79	-0.003080	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	VL	NT	-7.93	-0.004168	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	VN	NT	-4.63	-0.002434	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	VH	NT	-9.41	-0.004946	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	VL	NT	-7.64	-0.004113	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	VN	NT	-8.37	-0.004506	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	VH	NT	-6.21	-0.003343	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	VL	NT	-6.11	-0.003250	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	VN	NT	-6.78	-0.003606	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	VH	NT	-7.64	-0.004064	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	VL	NT	-10.17	-0.005346	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	VN	NT	-6.79	-0.003569	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	VH	NT	-7.08	-0.003721	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	VL	NT	-4.22	-0.002269	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	VN	NT	-2.93	-0.001575	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	VH	NT	3.98	0.002140	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	VL	NT	-7.87	-0.004186	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	VN	NT	-8.78	-0.004670	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	VH	NT	-8.50	-0.004521	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	VL	NT	-4.79	-0.002521	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	VN	NT	-6.02	-0.003168	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	VH	NT	-6.67	-0.003511	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	VL	NT	-5.04	-0.002710	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	VN	NT	3.46	0.001860	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	VH	NT	6.27	0.003371	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	VL	NT	-9.51	-0.005059	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	VN	NT	-6.90	-0.003670	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	VH	NT	-7.41	-0.003941	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	VL	NT	-7.84	-0.004126	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	VN	NT	-3.96	-0.002084	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	VH	NT	-4.32	-0.002274	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com

Appendix G: Frequency stability VS Temperature

Test Result

Temperature										
Band	Bandwidth	Modulation	Channel	RB Configure	Voltage [Vdc]	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
Band2	1.4MHz	QPSK	18607	6RB#0	NV	-30	-5.46	-0.002950	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	-20	-4.58	-0.002475	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	0	-7.05	-0.003809	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	10	-5.08	-0.002745	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	20	-6.14	-0.003318	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	-30	-7.17	-0.003814	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	-20	-7.31	-0.003888	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	0	-5.31	-0.002824	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	10	-9.24	-0.004915	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	20	-7.18	-0.003819	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	-30	2.13	0.001116	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	-20	-4.03	-0.002111	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	0	4.89	0.002561	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	10	-4.39	-0.002299	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	20	-3.76	-0.001969	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	-30	-5.38	-0.002907	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	-20	-4.39	-0.002372	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	0	-5.62	-0.003037	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	10	-5.22	-0.002821	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	20	-7.14	-0.003858	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	-30	-8.57	-0.004559	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	-20	-11.07	-0.005888	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	0	-5.95	-0.003165	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	10	-5.09	-0.002707	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	20	-8.87	-0.004718	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	-30	-4.92	-0.002577	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	-20	-5.65	-0.002959	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	0	-3.88	-0.002032	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	10	4.16	0.002179	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	20	-2.90	-0.001519	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	-30	-7.47	-0.004035	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	-20	-7.12	-0.003846	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	0	-7.28	-0.003932	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	10	-6.28	-0.003392	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	20	-5.22	-0.002819	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com

Hotline
 400-003-0500
 www.anbotek.com

Band2	3MHz	QPSK	18900	15RB#0	NV	-30	-7.74	-0.004117	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	-20	-8.40	-0.004468	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	0	-8.00	-0.004255	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	10	-7.64	-0.004064	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	20	-6.87	-0.003654	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	-30	2.65	0.001389	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	-20	4.71	0.002468	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	0	-5.92	-0.003102	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	10	-3.10	-0.001624	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	20	-4.33	-0.002269	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	-30	-4.86	-0.002625	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	-20	-5.06	-0.002733	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	0	-7.82	-0.004224	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	10	-5.24	-0.002830	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	20	-8.17	-0.004413	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	-30	-6.37	-0.003388	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	-20	-7.44	-0.003957	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	0	-7.82	-0.004160	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	10	-8.30	-0.004415	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	20	-10.64	-0.005660	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	-30	4.62	0.002421	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	-20	-3.99	-0.002091	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	0	3.03	0.001588	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	10	-4.16	-0.002180	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	20	6.05	0.003170	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	-30	-6.18	-0.003336	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	-20	-5.29	-0.002856	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	0	-4.22	-0.002278	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	10	-3.69	-0.001992	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	20	-5.92	-0.003196	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	-30	-5.91	-0.003144	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	-20	-5.08	-0.002702	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	0	-6.31	-0.003356	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	10	-9.58	-0.005096	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	20	-6.61	-0.003516	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	-30	-3.92	-0.002055	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	-20	-4.13	-0.002165	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	0	6.39	0.003350	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	10	3.98	0.002087	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	20	-7.95	-0.004168	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	-30	-6.75	-0.003644	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com

Band2	5MHz	16QAM	18625	25RB#0	NV	-20	-8.17	-0.004410	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	0	-5.45	-0.002942	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	10	-5.55	-0.002996	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	20	-5.31	-0.002866	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	-30	-7.37	-0.003920	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	-20	-6.15	-0.003271	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	0	-6.87	-0.003654	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	10	-10.59	-0.005633	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	20	-4.75	-0.002527	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	-30	-5.42	-0.002841	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	-20	-6.65	-0.003486	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	0	5.95	0.003119	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	10	4.22	0.002212	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	20	2.90	0.001520	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	-30	-6.77	-0.003650	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	-20	-5.42	-0.002922	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	0	-4.38	-0.002361	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	10	-5.34	-0.002879	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	20	-6.27	-0.003380	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	-30	-7.67	-0.004080	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	-20	-7.04	-0.003745	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	0	-3.59	-0.001910	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	10	-8.23	-0.004378	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	20	-5.25	-0.002793	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	-30	3.81	0.002000	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	-20	6.01	0.003155	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	0	2.16	0.001134	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	10	4.53	0.002378	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	20	-5.08	-0.002667	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	-30	-6.71	-0.003617	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	-20	-6.14	-0.003310	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	0	-8.05	-0.004340	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	10	-5.59	-0.003013	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	20	-6.55	-0.003531	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	-30	-8.38	-0.004457	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	-20	-2.83	-0.001505	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	0	-5.79	-0.003080	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	10	-5.21	-0.002771	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	20	-5.74	-0.003053	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	-30	-4.26	-0.002236	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	-20	4.23	0.002220	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com

Band2	10MHz	16QAM	19150	50RB#0	NV	0	4.58	0.002404	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	10	-3.33	-0.001748	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	20	3.81	0.002000	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	-30	-4.86	-0.002616	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	-20	-6.34	-0.003413	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	0	-10.23	-0.005507	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	10	-7.67	-0.004129	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	20	-8.34	-0.004490	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	-30	-6.31	-0.003356	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	-20	-7.47	-0.003973	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	0	-6.84	-0.003638	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	10	-8.08	-0.004298	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	20	-8.74	-0.004649	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	-30	-6.82	-0.003585	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	-20	-7.18	-0.003774	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	0	-6.87	-0.003611	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	10	-6.18	-0.003248	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	20	-7.30	-0.003837	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	-30	-8.61	-0.004635	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	-20	-7.24	-0.003898	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	0	-10.14	-0.005459	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	10	-8.41	-0.004528	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	20	-4.78	-0.002573	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	-30	-8.34	-0.004436	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	-20	-6.91	-0.003676	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	0	-6.31	-0.003356	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	10	-6.35	-0.003378	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	20	-8.98	-0.004777	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	-30	-8.25	-0.004336	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	-20	-7.88	-0.004142	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	0	-7.48	-0.003932	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	10	-7.08	-0.003721	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	20	-5.85	-0.003075	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	-30	-3.45	-0.001855	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	-20	4.78	0.002570	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	0	-2.89	-0.001554	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	10	3.33	0.001790	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	20	4.18	0.002247	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	-30	-6.74	-0.003585	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	-20	-6.57	-0.003495	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	0	-7.45	-0.003963	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com

Band2	20MHz	QPSK	18900	100RB#0	NV	10	-4.78	-0.002543	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	20	-10.13	-0.005388	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	-30	-3.78	-0.001989	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	-20	-8.41	-0.004426	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	0	-9.71	-0.005111	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	10	-5.32	-0.002800	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	20	-6.19	-0.003258	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	-30	-3.32	-0.001785	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	-20	5.44	0.002925	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	0	-6.27	-0.003371	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	10	5.24	0.002817	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	20	-3.83	-0.002059	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	-30	-10.10	-0.005372	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	-20	-8.90	-0.004734	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	0	-9.20	-0.004894	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	10	-7.77	-0.004133	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	20	-7.20	-0.003830	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	-30	-9.90	-0.005211	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	-20	-4.13	-0.002174	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	0	-7.30	-0.003842	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	10	-8.94	-0.004705	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	20	-5.69	-0.002995	±2.5	PASS

---End---