



Band5-3MHz-QPSK-20635-1RB#0



Band5-3MHz-QPSK-20635-1RB#14



Band5-3MHz-QPSK-20635-15RB#0



Band5-3MHz-16QAM-20415-1RB#0




Band5-3MHz-16QAM-20415-1RB#14



Band5-3MHz-16QAM-20415-15RB#0



Band5-3MHz-16QAM-20635-1RB#0

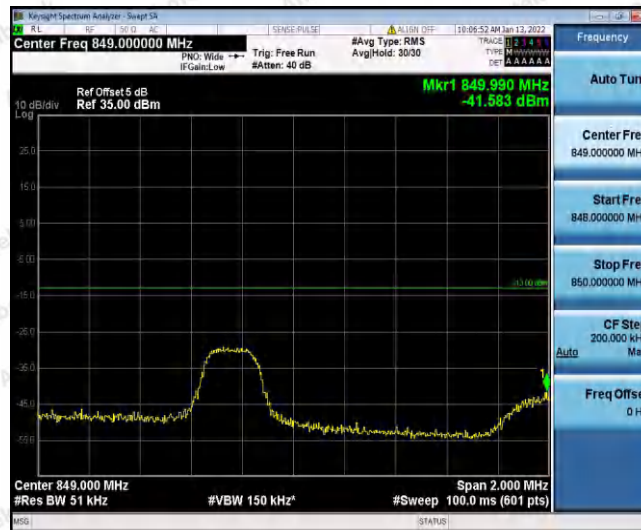


Band5-3MHz-16QAM-20635-1RB#14



Band5-3MHz-16QAM-20635-15RB#0



Band5-5MHz-QPSK-20425-1RB#0

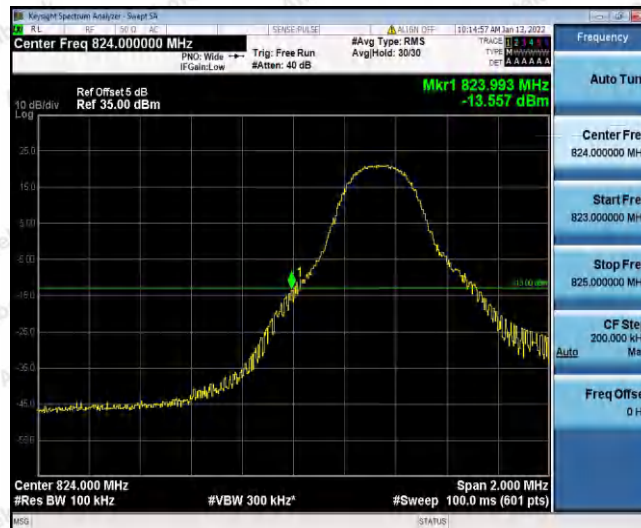

Band5-5MHz-QPSK-20425-1RB#24



Band5-5MHz-QPSK-20425-25RB#0

Shenzhen Anbotech Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com



Hotline

400-003-0500


www.anbotech.com



Band5-5MHz-QPSK-20625-1RB#0




Band5-5MHz-QPSK-20625-1RB#24

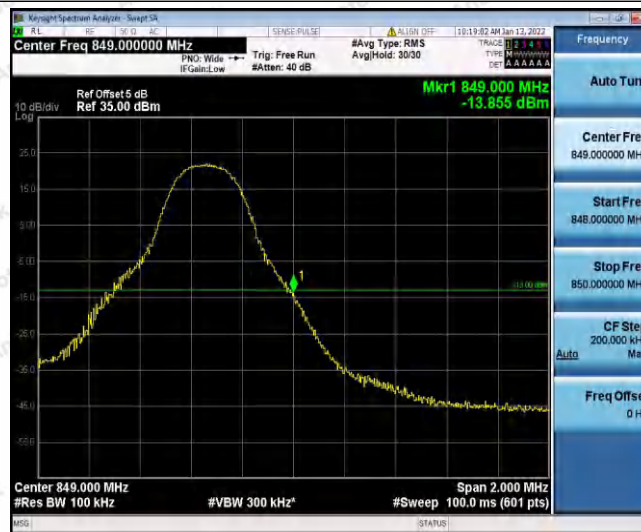

Band5-5MHz-QPSK-20625-25RB#0



Band5-5MHz-16QAM-20425-1RB#0

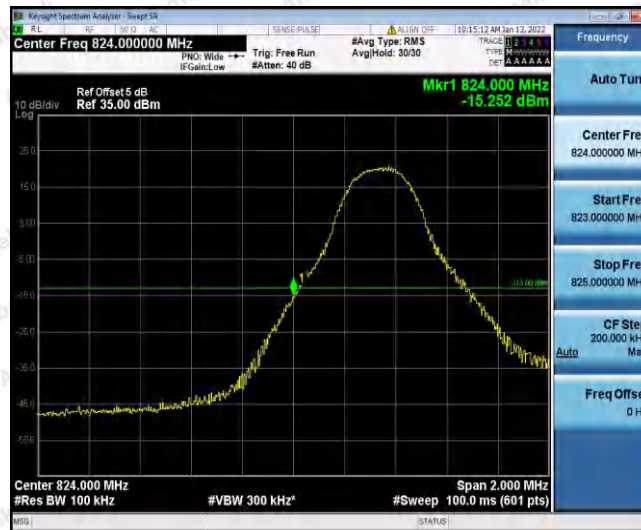

Band5-5MHz-16QAM-20425-1RB#24




Band5-5MHz-16QAM-20425-25RB#0



Band5-5MHz-16QAM-20625-1RB#0



Band5-5MHz-16QAM-20625-1RB#24

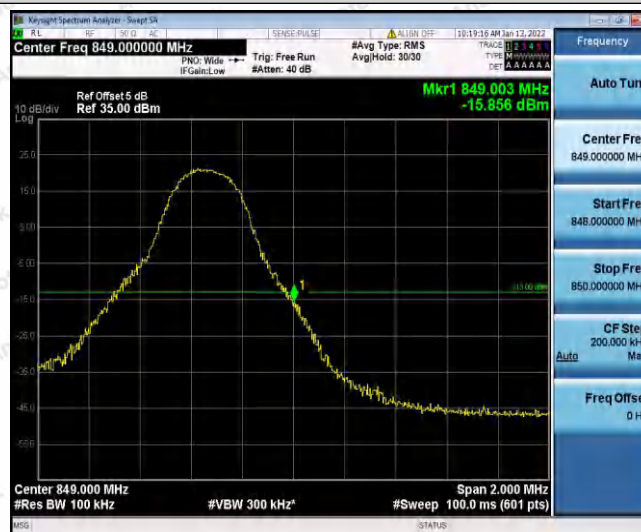

Band5-5MHz-16QAM-20625-25RB#0



Band5-10MHz-QPSK-20450-1RB#0



Band5-10MHz-QPSK-20450-1RB#49




Band5-10MHz-QPSK-20450-50RB#0



Band5-10MHz-QPSK-20600-1RB#0




Band5-10MHz-QPSK-20600-1RB#49

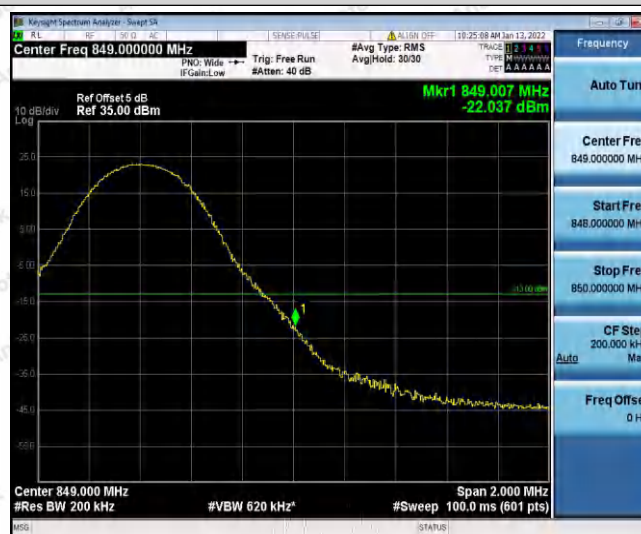

Band5-10MHz-QPSK-20600-50RB#0



Band5-10MHz-16QAM-20450-1RB#0

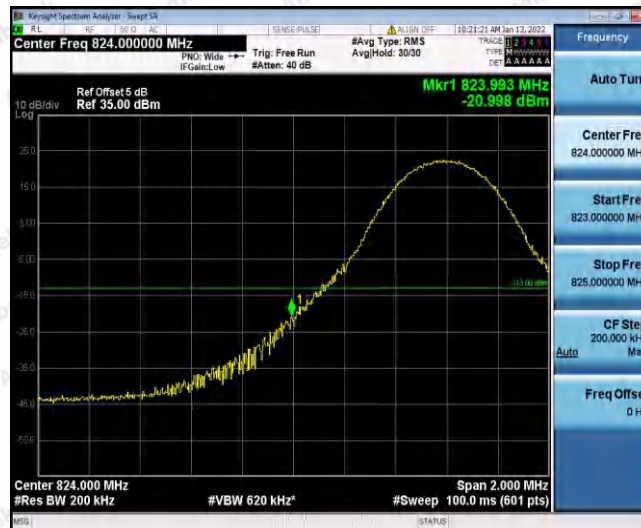

Band5-10MHz-16QAM-20450-1RB#49



Band5-10MHz-16QAM-20450-50RB#0

Shenzhen Anbotech Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com



Hotline

400-003-0500

www.anbotech.com



Band5-10MHz-16QAM-20600-1RB#0



Band5-10MHz-16QAM-20600-1RB#49



Band5-10MHz-16QAM-20600-50RB#0



Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com

Appendix E: Conducted Spurious Emission


Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Frequency Range	Result (dBm)	Verdict
Band5	1.4MHz	QPSK	20407	1RB#0	Range1:30~1000MHz	-30.45	PASS
Band5	1.4MHz	QPSK	20407	1RB#0	Range2:1000~10000MHz	-36.27	PASS
Band5	1.4MHz	QPSK	20525	1RB#0	Range1:30~1000MHz	-29.1	PASS
Band5	1.4MHz	QPSK	20525	1RB#0	Range2:1000~10000MHz	-39.14	PASS
Band5	1.4MHz	QPSK	20643	1RB#0	Range1:30~1000MHz	-26.16	PASS
Band5	1.4MHz	QPSK	20643	1RB#0	Range2:1000~10000MHz	-39.34	PASS
Band5	1.4MHz	16QAM	20407	1RB#0	Range1:30~1000MHz	-30.16	PASS
Band5	1.4MHz	16QAM	20407	1RB#0	Range2:1000~10000MHz	-34.92	PASS
Band5	1.4MHz	16QAM	20525	1RB#0	Range1:30~1000MHz	-30.64	PASS
Band5	1.4MHz	16QAM	20525	1RB#0	Range2:1000~10000MHz	-39.1	PASS
Band5	1.4MHz	16QAM	20643	1RB#0	Range1:30~1000MHz	-25.88	PASS
Band5	1.4MHz	16QAM	20643	1RB#0	Range2:1000~10000MHz	-39.96	PASS
Band5	3MHz	QPSK	20415	1RB#0	Range1:30~1000MHz	-30.05	PASS
Band5	3MHz	QPSK	20415	1RB#0	Range2:1000~10000MHz	-36.61	PASS
Band5	3MHz	QPSK	20525	1RB#0	Range1:30~1000MHz	-28.95	PASS
Band5	3MHz	QPSK	20525	1RB#0	Range2:1000~10000MHz	-38.46	PASS
Band5	3MHz	QPSK	20635	1RB#0	Range1:30~1000MHz	-25.97	PASS
Band5	3MHz	QPSK	20635	1RB#0	Range2:1000~10000MHz	-36.61	PASS
Band5	3MHz	16QAM	20415	1RB#0	Range1:30~1000MHz	-31.1	PASS
Band5	3MHz	16QAM	20415	1RB#0	Range2:1000~10000MHz	-36.45	PASS
Band5	3MHz	16QAM	20525	1RB#0	Range1:30~1000MHz	-29.63	PASS
Band5	3MHz	16QAM	20525	1RB#0	Range2:1000~10000MHz	-39.92	PASS
Band5	3MHz	16QAM	20635	1RB#0	Range1:30~1000MHz	-26.05	PASS
Band5	3MHz	16QAM	20635	1RB#0	Range2:1000~10000MHz	-38.37	PASS
Band5	5MHz	QPSK	20425	1RB#0	Range1:30~1000MHz	-30.42	PASS
Band5	5MHz	QPSK	20425	1RB#0	Range2:1000~10000MHz	-36.15	PASS
Band5	5MHz	QPSK	20525	1RB#0	Range1:30~1000MHz	-29.43	PASS
Band5	5MHz	QPSK	20525	1RB#0	Range2:1000~10000MHz	-35.74	PASS
Band5	5MHz	QPSK	20625	1RB#0	Range1:30~1000MHz	-26.96	PASS
Band5	5MHz	QPSK	20625	1RB#0	Range2:1000~10000MHz	-38.55	PASS
Band5	5MHz	16QAM	20425	1RB#0	Range1:30~1000MHz	-30.07	PASS
Band5	5MHz	16QAM	20425	1RB#0	Range2:1000~10000MHz	-35.96	PASS
Band5	5MHz	16QAM	20525	1RB#0	Range1:30~1000MHz	-29.72	PASS
Band5	5MHz	16QAM	20525	1RB#0	Range2:1000~10000MHz	-38.64	PASS
Band5	5MHz	16QAM	20625	1RB#0	Range1:30~1000MHz	-26.08	PASS


Band5	5MHz	16QAM	20625	1RB#0	Range2:1000~10000MHz	-39.27	PASS
Band5	10MHz	QPSK	20450	1RB#0	Range1:30~1000MHz	-30.03	PASS
Band5	10MHz	QPSK	20450	1RB#0	Range2:1000~10000MHz	-36.54	PASS
Band5	10MHz	QPSK	20525	1RB#0	Range1:30~1000MHz	-29.69	PASS
Band5	10MHz	QPSK	20525	1RB#0	Range2:1000~10000MHz	-35.48	PASS
Band5	10MHz	QPSK	20600	1RB#0	Range1:30~1000MHz	-27.2	PASS
Band5	10MHz	QPSK	20600	1RB#0	Range2:1000~10000MHz	-36.49	PASS
Band5	10MHz	16QAM	20450	1RB#0	Range1:30~1000MHz	-30.29	PASS
Band5	10MHz	16QAM	20450	1RB#0	Range2:1000~10000MHz	-36.28	PASS
Band5	10MHz	16QAM	20525	1RB#0	Range1:30~1000MHz	-30.1	PASS
Band5	10MHz	16QAM	20525	1RB#0	Range2:1000~10000MHz	-39.45	PASS
Band5	10MHz	16QAM	20600	1RB#0	Range1:30~1000MHz	-27.16	PASS
Band5	10MHz	16QAM	20600	1RB#0	Range2:1000~10000MHz	-38.37	PASS

Test Graphs

Band5-1.4MHz-QPSK-20407-1RB#0-Range1:30~1000MHz

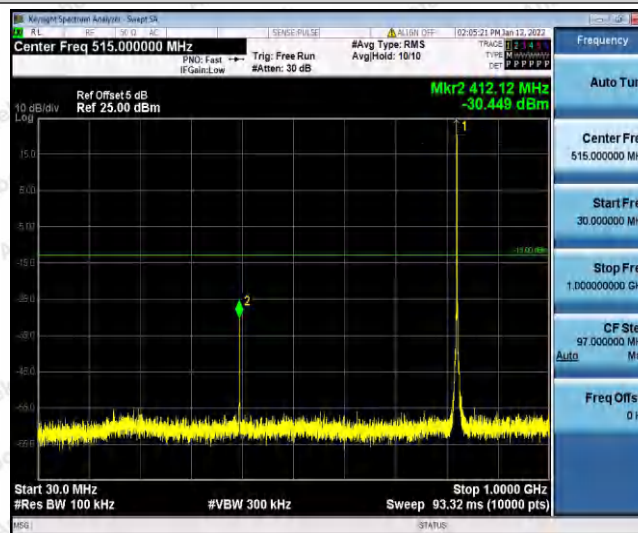

Band5-1.4MHz-QPSK-20407-1RB#0-Range2:1000~10000MHz

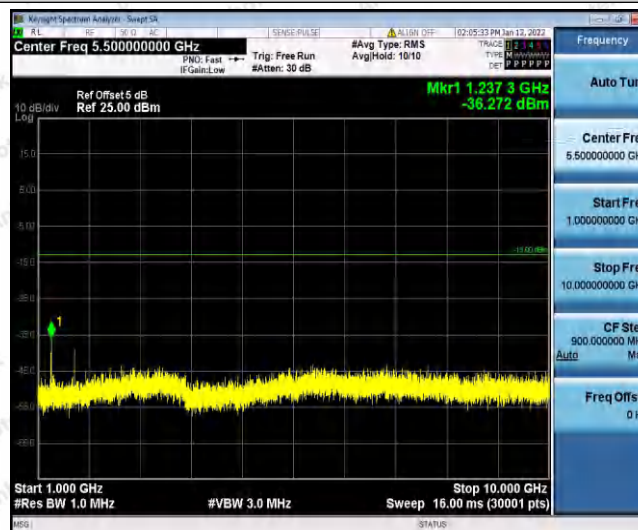

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline


400-003-0500

www.anbotek.com


Band5-1.4MHz-QPSK-20525-1RB#0-Range1:30~1000MHz

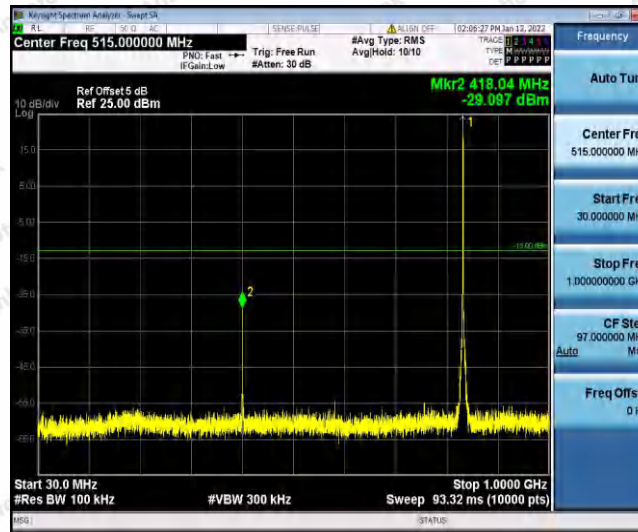

Band5-1.4MHz-QPSK-20525-1RB#0-Range2:1000~10000MHz

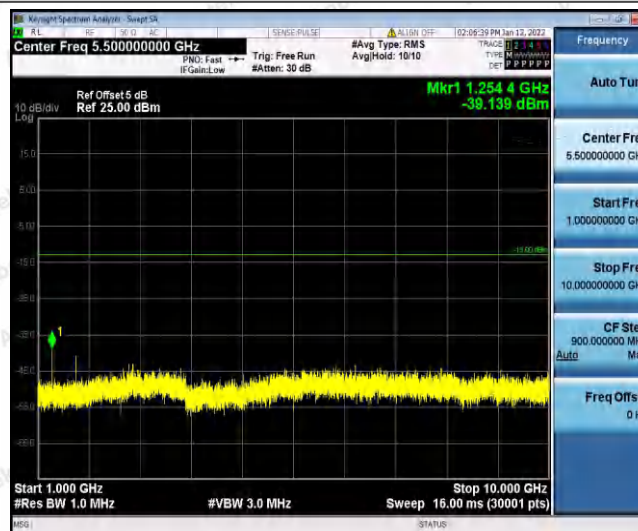

Band5-1.4MHz-QPSK-20643-1RB#0-Range1:30~1000MHz

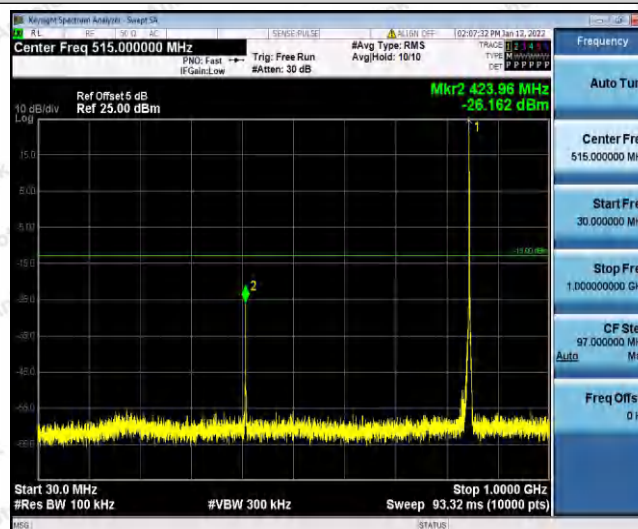

Band5-1.4MHz-QPSK-20643-1RB#0-Range2:1000~10000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline

400-003-0500


www.anbotek.com

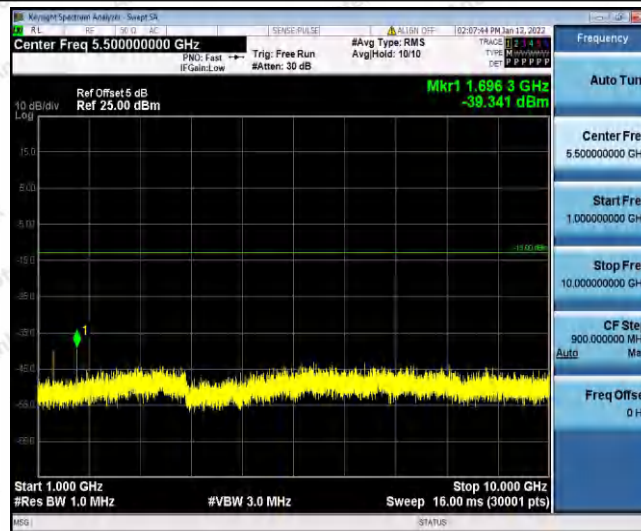


Band5-1.4MHz-16QAM-20407-1RB#0-Range1:30~1000MHz

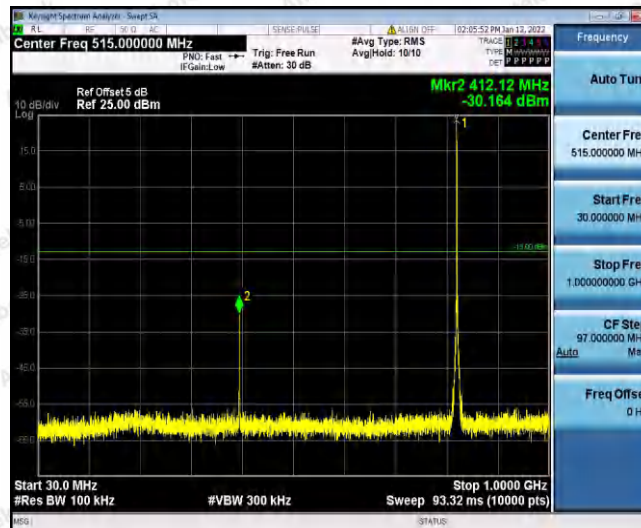


Band5-1.4MHz-16QAM-20407-1RB#0-Range2:1000~10000MHz

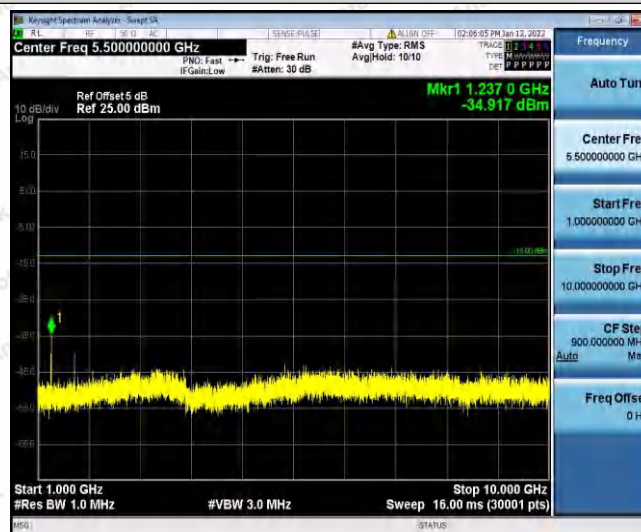


Band5-1.4MHz-16QAM-20525-1RB#0-Range1:30~1000MHz

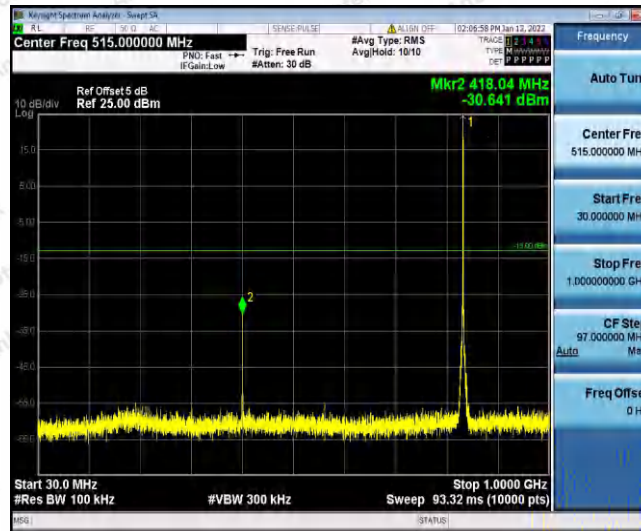


Band5-1.4MHz-16QAM-20525-1RB#0-Range2:1000~10000MHz

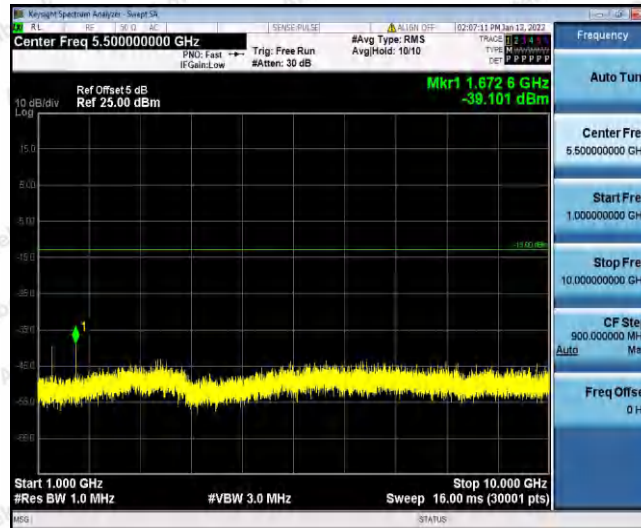


Band5-1.4MHz-16QAM-20643-1RB#0-Range1:30~1000MHz

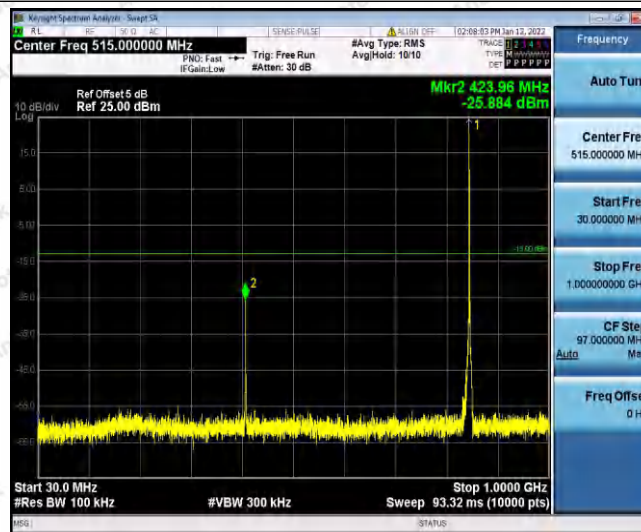


Band5-1.4MHz-16QAM-20643-1RB#0-Range2:1000~10000MHz

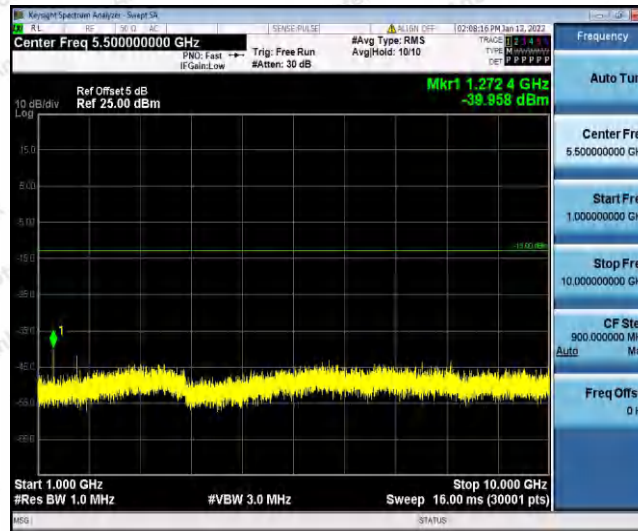


Band5-3MHz-QPSK-20415-1RB#0-Range1:30~1000MHz

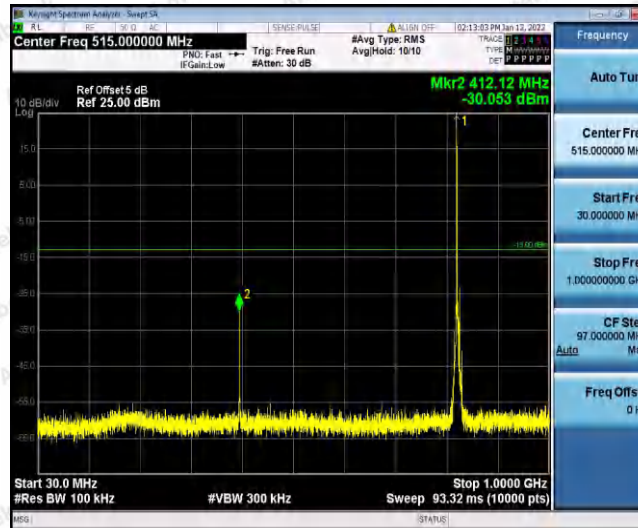


Band5-3MHz-QPSK-20415-1RB#0-Range2:1000~10000MHz

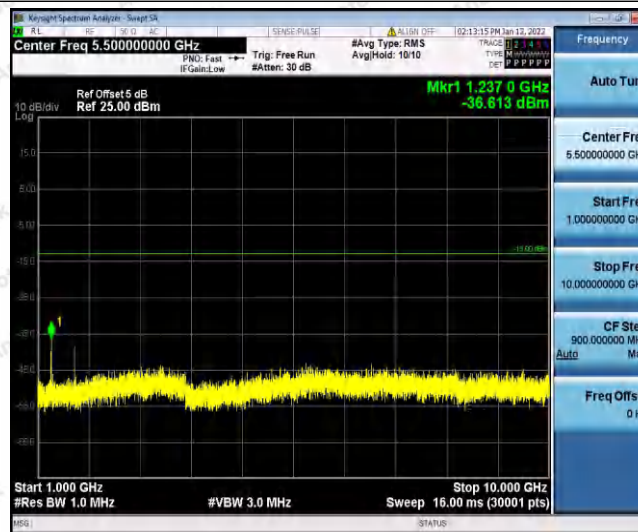


Band5-3MHz-QPSK-20525-1RB#0-Range1:30~1000MHz

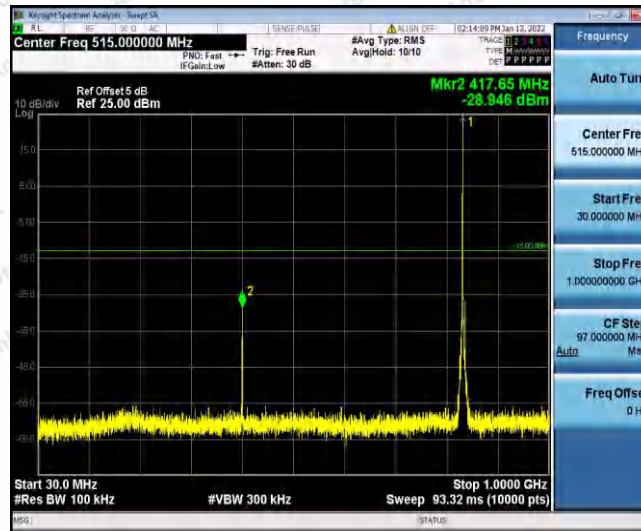


Band5-3MHz-QPSK-20525-1RB#0-Range2:1000~10000MHz

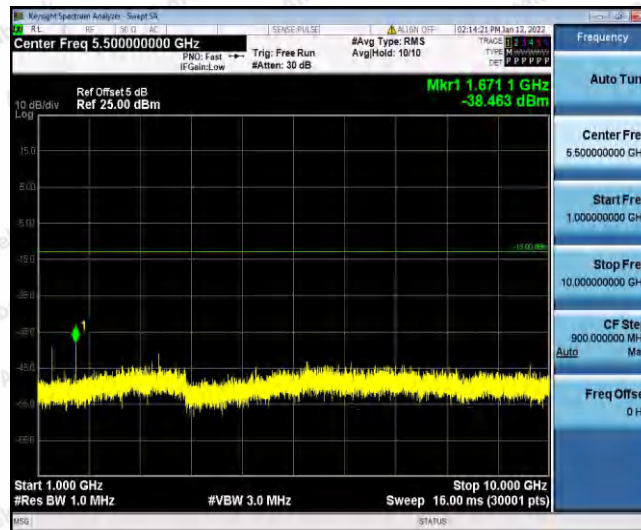


Band5-3MHz-QPSK-20635-1RB#0-Range1:30~1000MHz

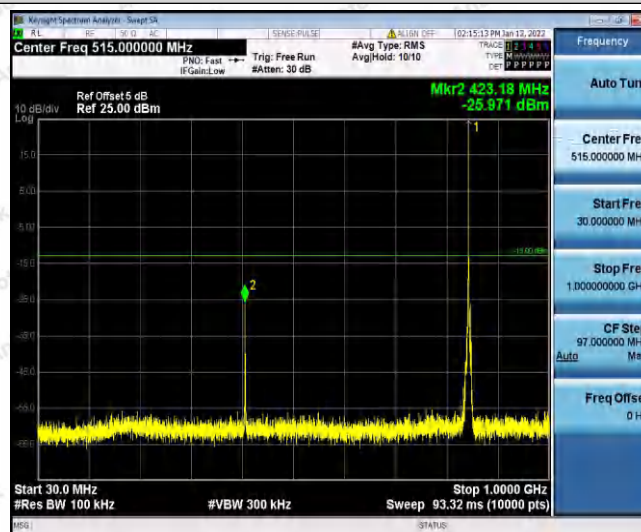


Band5-3MHz-QPSK-20635-1RB#0-Range2:1000~10000MHz

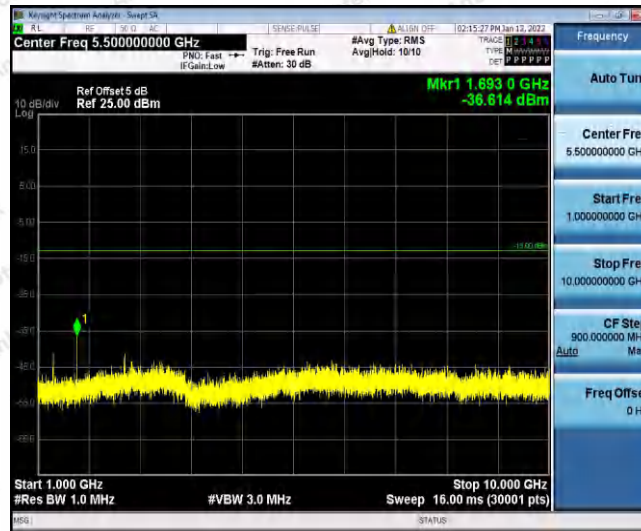


Band5-3MHz-16QAM-20415-1RB#0-Range1:30~1000MHz

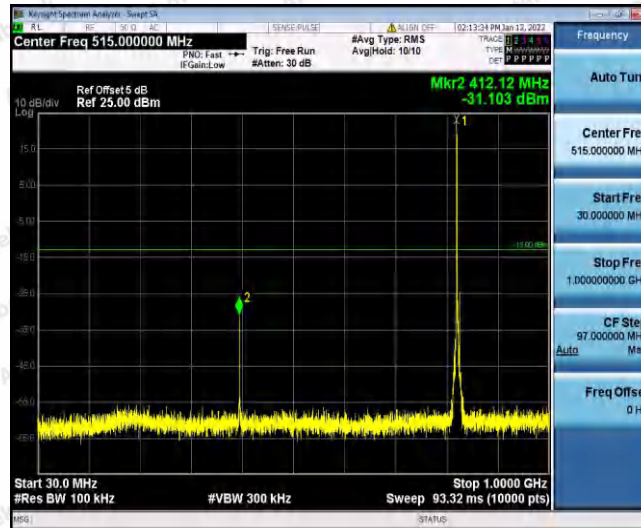


Band5-3MHz-16QAM-20415-1RB#0-Range2:1000~10000MHz

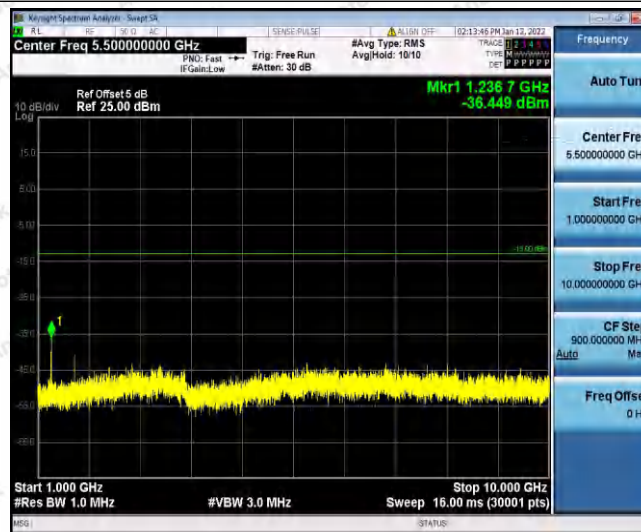


Band5-3MHz-16QAM-20525-1RB#0-Range1:30~1000MHz

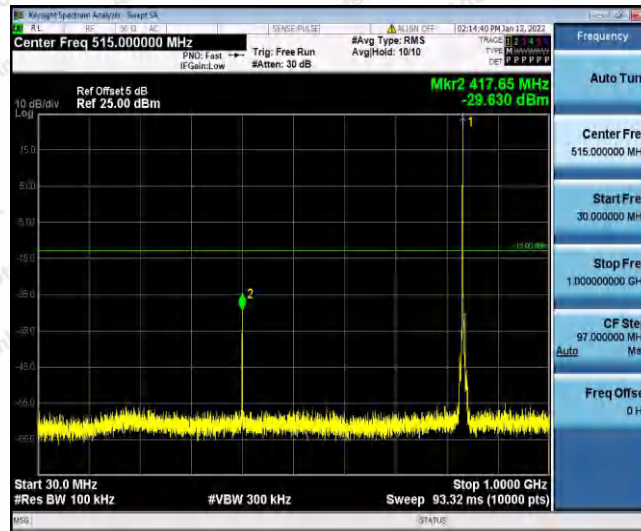


Band5-3MHz-16QAM-20525-1RB#0-Range2:1000~10000MHz

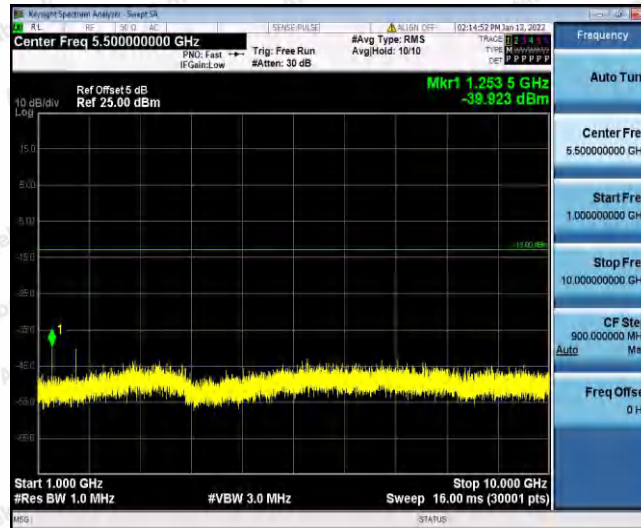


Band5-3MHz-16QAM-20635-1RB#0-Range1:30~1000MHz

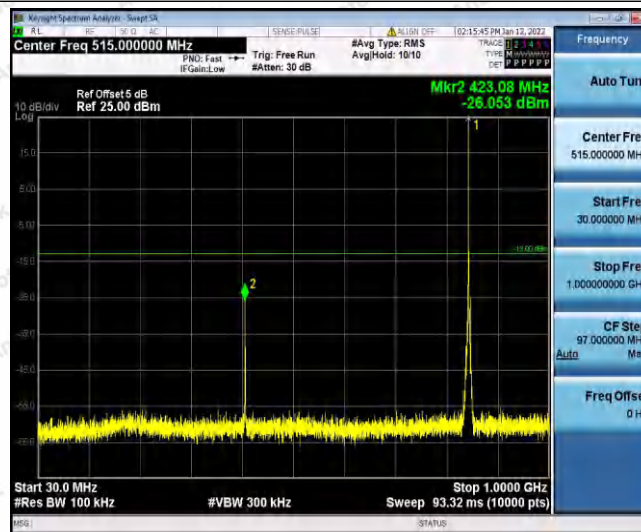

Band5-3MHz-16QAM-20635-1RB#0-Range2:1000~10000MHz

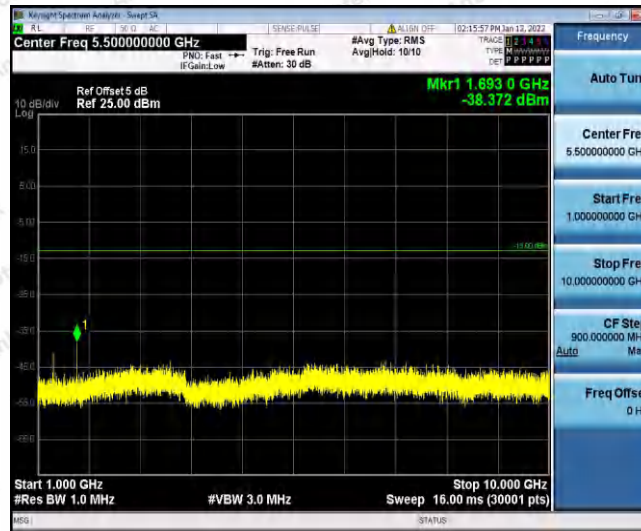


Band5-5MHz-QPSK-20425-1RB#0-Range1:30~1000MHz

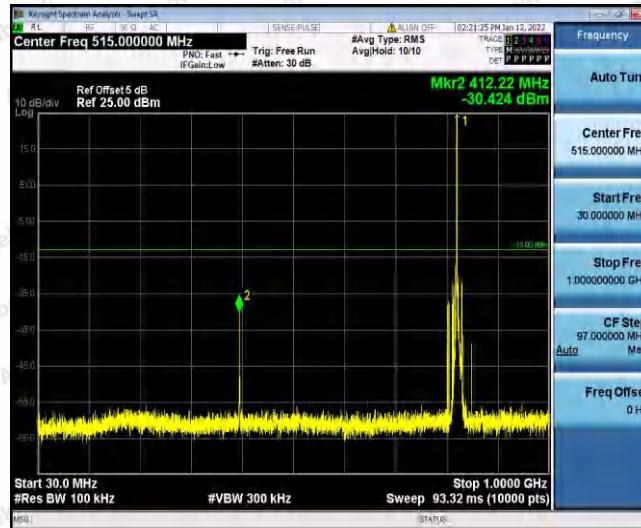


Band5-5MHz-QPSK-20425-1RB#0-Range2:1000~10000MHz




Band5-5MHz-QPSK-20525-1RB#0-Range1:30~1000MHz

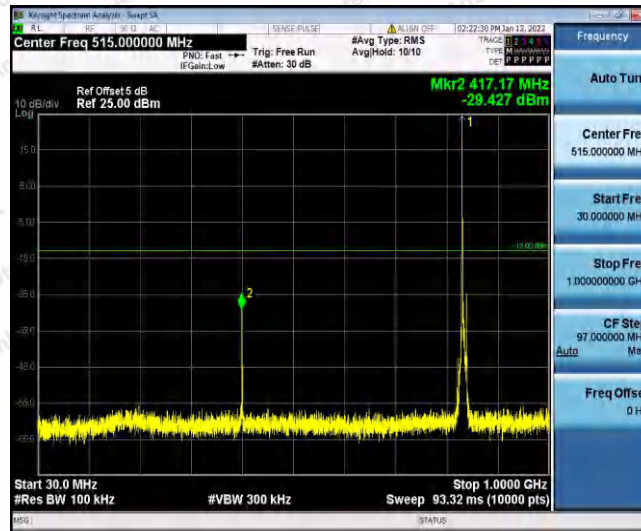

Band5-5MHz-QPSK-20525-1RB#0-Range2:1000~10000MHz

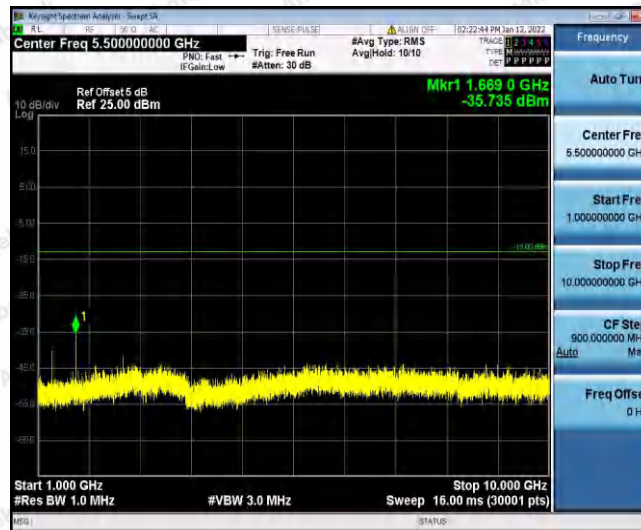


Band5-5MHz-QPSK-20625-1RB#0-Range1:30~1000MHz

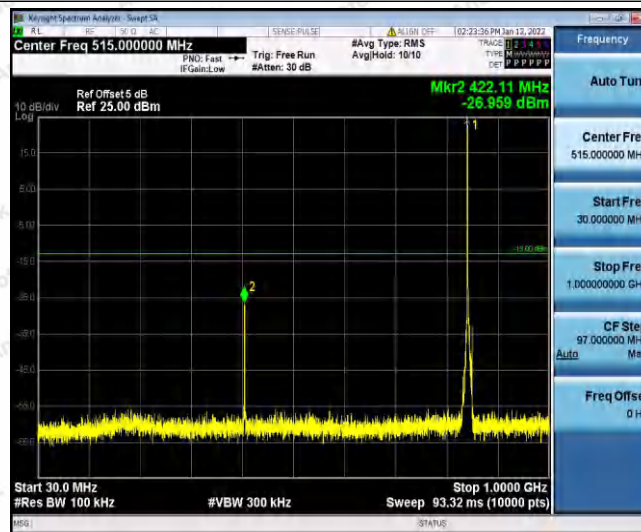


Band5-5MHz-QPSK-20625-1RB#0-Range2:1000~10000MHz




Band5-5MHz-16QAM-20425-1RB#0-Range1:30~1000MHz

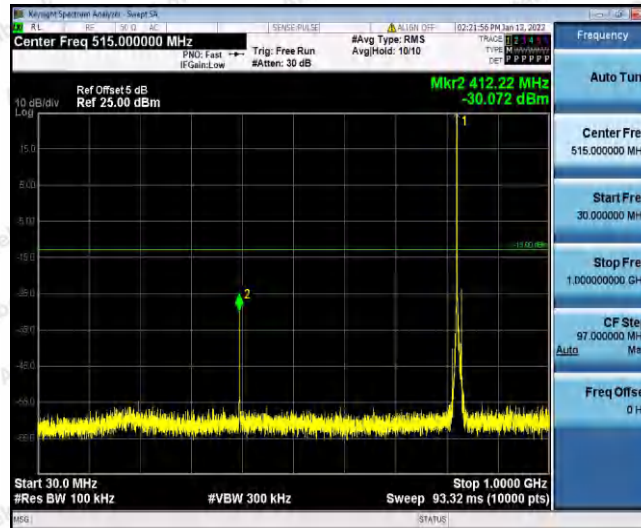


Band5-5MHz-16QAM-20425-1RB#0-Range2:1000~10000MHz

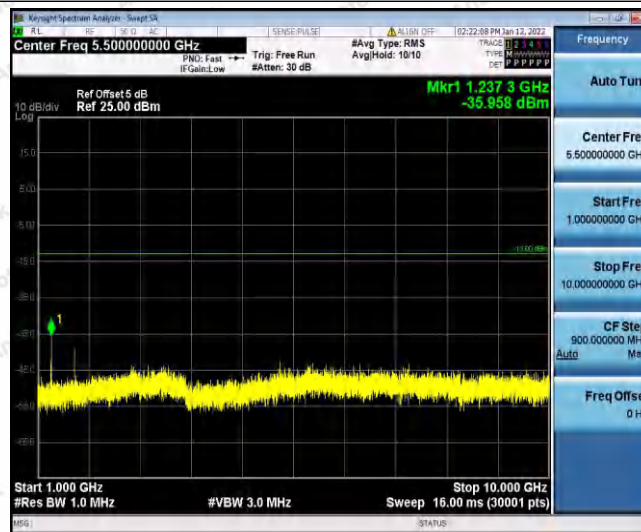


Band5-5MHz-16QAM-20525-1RB#0-Range1:30~1000MHz

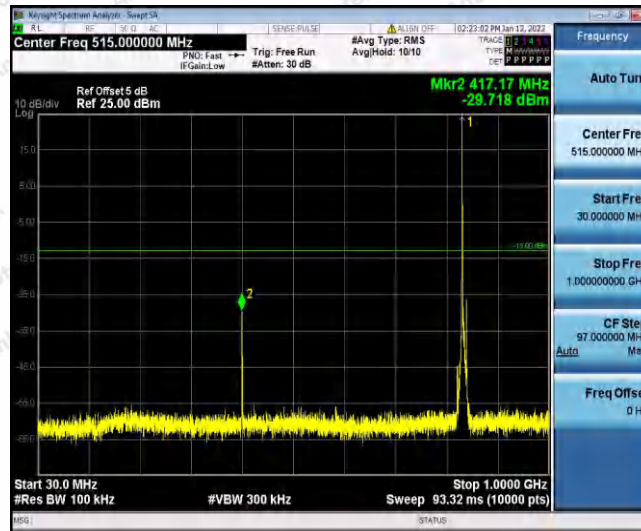


Band5-5MHz-16QAM-20525-1RB#0-Range2:1000~10000MHz

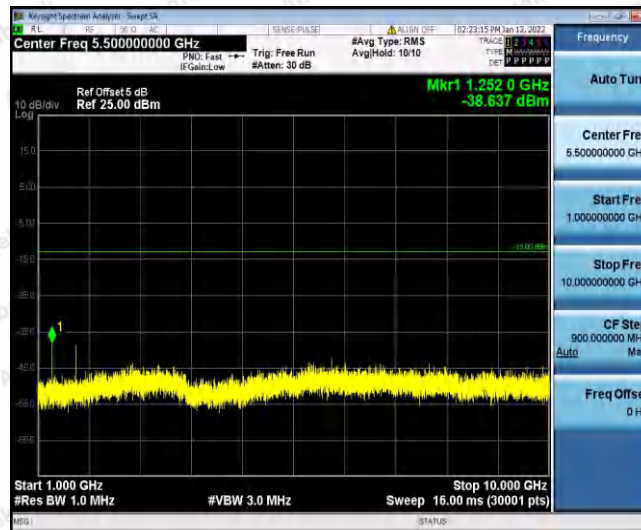


Band5-5MHz-16QAM-20625-1RB#0-Range1:30~1000MHz

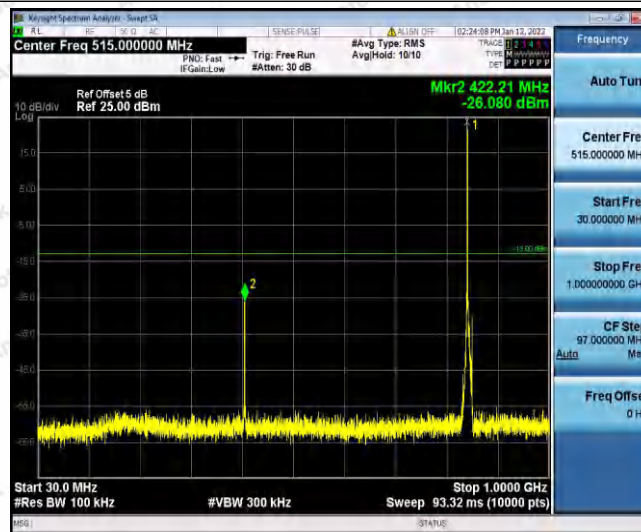


Band5-5MHz-16QAM-20625-1RB#0-Range2:1000~10000MHz

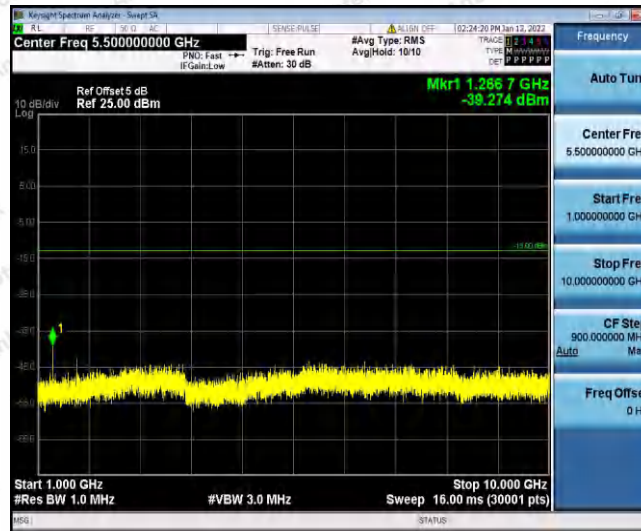


Band5-10MHz-QPSK-20450-1RB#0-Range1:30~1000MHz

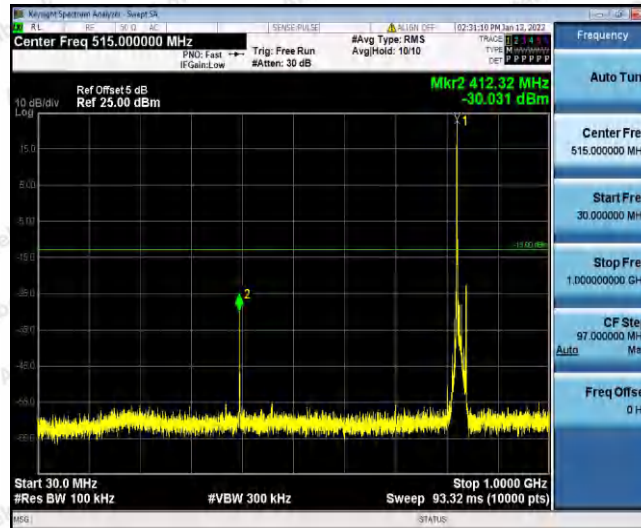


Band5-10MHz-QPSK-20450-1RB#0-Range2:1000~10000MHz

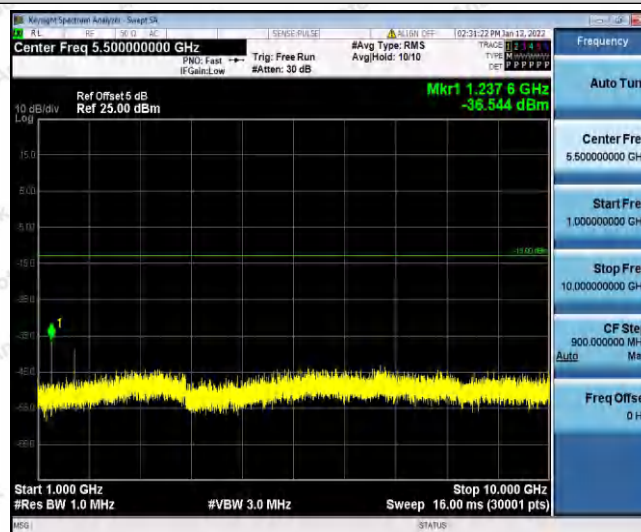


Band5-10MHz-QPSK-20525-1RB#0-Range1:30~1000MHz

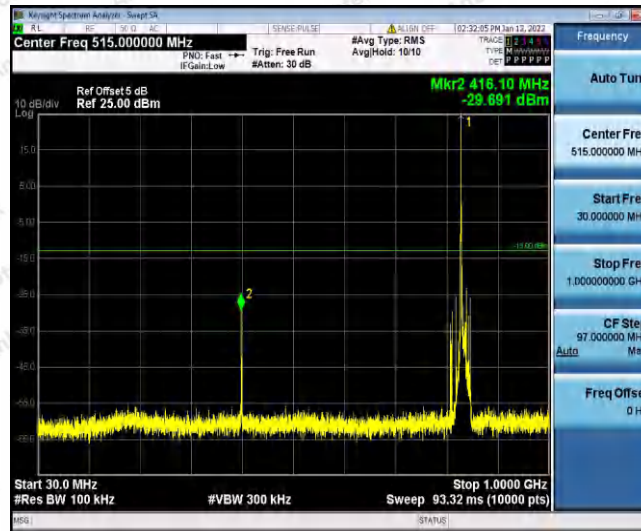


Band5-10MHz-QPSK-20525-1RB#0-Range2:1000~10000MHz

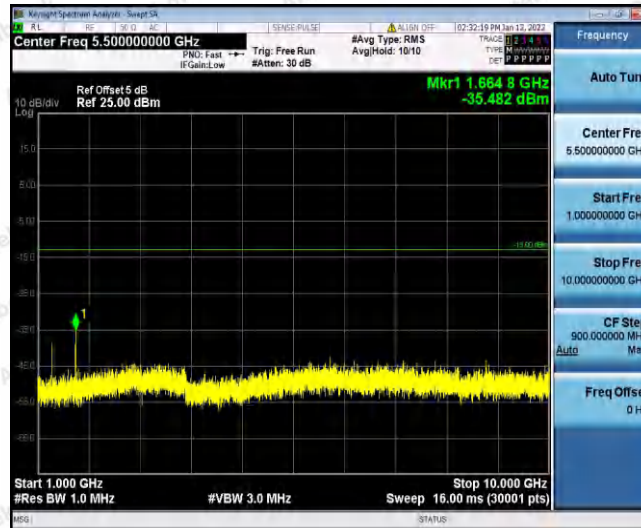


Band5-10MHz-QPSK-20600-1RB#0-Range1:30~1000MHz

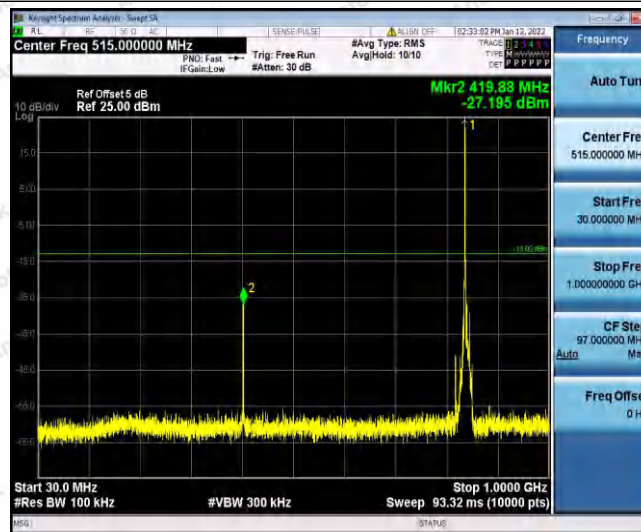


Band5-10MHz-QPSK-20600-1RB#0-Range2:1000~10000MHz

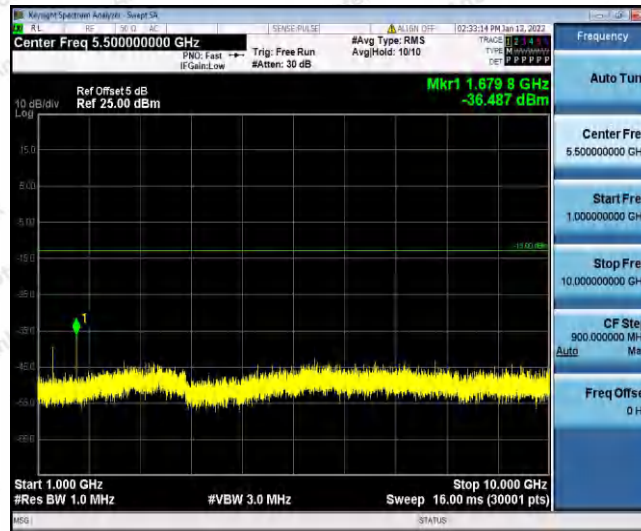


Band5-10MHz-16QAM-20450-1RB#0-Range1:30~1000MHz

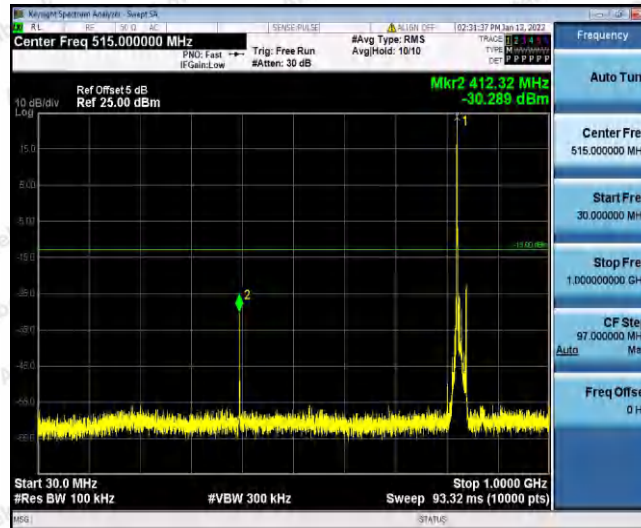

Band5-10MHz-16QAM-20450-1RB#0-Range2:1000~10000MHz

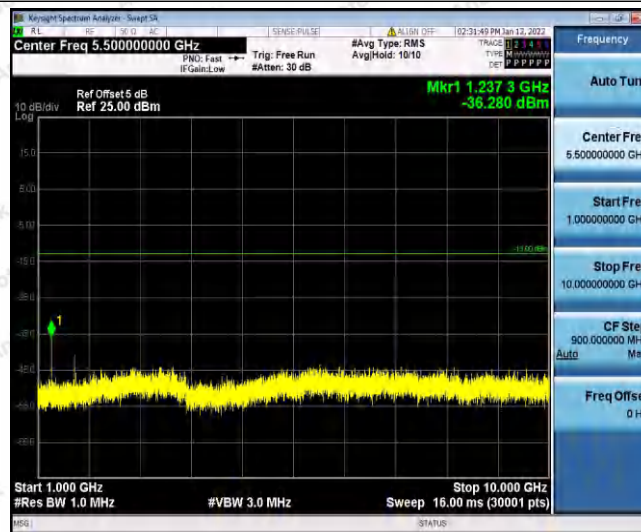


Band5-10MHz-16QAM-20525-1RB#0-Range1:30~1000MHz

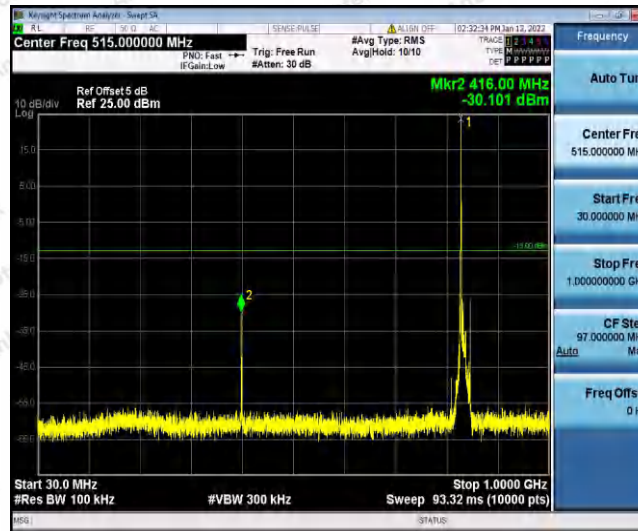


Band5-10MHz-16QAM-20525-1RB#0-Range2:1000~10000MHz



Band5-10MHz-16QAM-20600-1RB#0-Range1:30~1000MHz

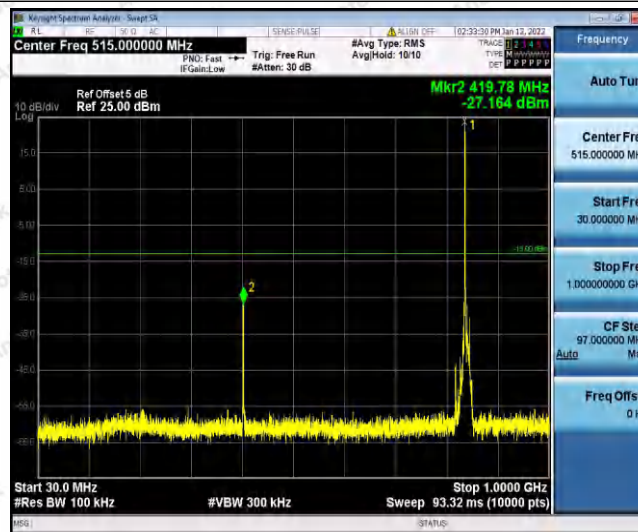

Band5-10MHz-16QAM-20600-1RB#0-Range2:1000~10000MHz

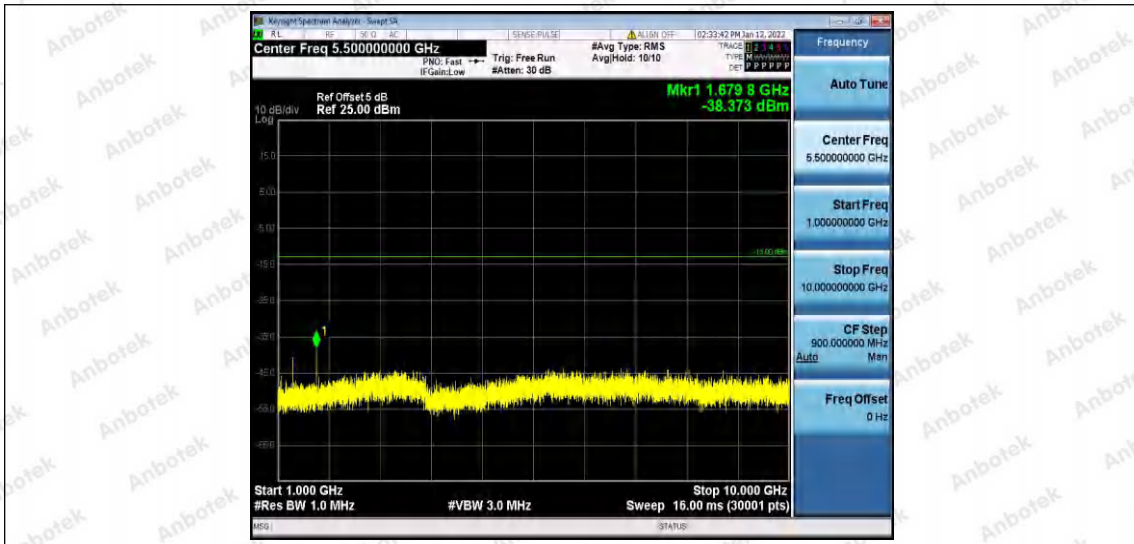

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com

Appendix F: Frequency Stability VS Voltage

Test Result

Voltage										
Band	Bandwidth	Modulation	Channel	RB Configure	Voltage [Vdc]	Temperature(°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
Band5	1.4MHz	QPSK	20407	6RB#0	VL	NT	-18.65	-0.022614	±2.5	PASS
Band5	1.4MHz	QPSK	20407	6RB#0	VN	NT	-20.86	-0.025294	±2.5	PASS
Band5	1.4MHz	QPSK	20407	6RB#0	VH	NT	-15.81	-0.019171	±2.5	PASS
Band5	1.4MHz	QPSK	20525	6RB#0	VL	NT	-7.81	-0.009337	±2.5	PASS
Band5	1.4MHz	QPSK	20525	6RB#0	VN	NT	-3.33	-0.003981	±2.5	PASS
Band5	1.4MHz	QPSK	20525	6RB#0	VH	NT	-6.07	-0.007256	±2.5	PASS
Band5	1.4MHz	QPSK	20643	6RB#0	VL	NT	-9.03	-0.010645	±2.5	PASS
Band5	1.4MHz	QPSK	20643	6RB#0	VN	NT	-2.40	-0.002829	±2.5	PASS
Band5	1.4MHz	QPSK	20643	6RB#0	VH	NT	-8.05	-0.009490	±2.5	PASS
Band5	1.4MHz	16QAM	20407	6RB#0	VL	NT	-12.69	-0.015387	±2.5	PASS
Band5	1.4MHz	16QAM	20407	6RB#0	VN	NT	-11.07	-0.013423	±2.5	PASS
Band5	1.4MHz	16QAM	20407	6RB#0	VH	NT	-11.89	-0.014417	±2.5	PASS
Band5	1.4MHz	16QAM	20525	6RB#0	VL	NT	-12.23	-0.014620	±2.5	PASS
Band5	1.4MHz	16QAM	20525	6RB#0	VN	NT	6.61	0.007902	±2.5	PASS
Band5	1.4MHz	16QAM	20525	6RB#0	VH	NT	-7.54	-0.009014	±2.5	PASS
Band5	1.4MHz	16QAM	20643	6RB#0	VL	NT	-7.60	-0.008959	±2.5	PASS
Band5	1.4MHz	16QAM	20643	6RB#0	VN	NT	-4.82	-0.005682	±2.5	PASS
Band5	1.4MHz	16QAM	20643	6RB#0	VH	NT	-4.61	-0.005434	±2.5	PASS
Band5	3MHz	QPSK	20415	15RB#0	VL	NT	-3.78	-0.004579	±2.5	PASS
Band5	3MHz	QPSK	20415	15RB#0	VN	NT	3.38	0.004094	±2.5	PASS
Band5	3MHz	QPSK	20415	15RB#0	VH	NT	-2.35	-0.002847	±2.5	PASS
Band5	3MHz	QPSK	20525	15RB#0	VL	NT	-4.22	-0.005045	±2.5	PASS
Band5	3MHz	QPSK	20525	15RB#0	VN	NT	-2.93	-0.003503	±2.5	PASS
Band5	3MHz	QPSK	20525	15RB#0	VH	NT	-3.65	-0.004363	±2.5	PASS
Band5	3MHz	QPSK	20635	15RB#0	VL	NT	-3.20	-0.003776	±2.5	PASS
Band5	3MHz	QPSK	20635	15RB#0	VN	NT	-3.86	-0.004555	±2.5	PASS
Band5	3MHz	QPSK	20635	15RB#0	VH	NT	-6.47	-0.007634	±2.5	PASS
Band5	3MHz	16QAM	20415	15RB#0	VL	NT	-2.70	-0.003271	±2.5	PASS
Band5	3MHz	16QAM	20415	15RB#0	VN	NT	-2.47	-0.002992	±2.5	PASS
Band5	3MHz	16QAM	20415	15RB#0	VH	NT	-2.52	-0.003053	±2.5	PASS
Band5	3MHz	16QAM	20525	15RB#0	VL	NT	-1.72	-0.002056	±2.5	PASS
Band5	3MHz	16QAM	20525	15RB#0	VN	NT	-1.77	-0.002116	±2.5	PASS
Band5	3MHz	16QAM	20525	15RB#0	VH	NT	-2.83	-0.003383	±2.5	PASS

Band5	3MHz	16QAM	20635	15RB#0	VL	NT	-3.72	-0.004389	±2.5	PASS
Band5	3MHz	16QAM	20635	15RB#0	VN	NT	-4.41	-0.005204	±2.5	PASS
Band5	3MHz	16QAM	20635	15RB#0	VH	NT	-4.76	-0.005617	±2.5	PASS
Band5	5MHz	QPSK	20425	25RB#0	VL	NT	-5.81	-0.007030	±2.5	PASS
Band5	5MHz	QPSK	20425	25RB#0	VN	NT	-8.41	-0.010175	±2.5	PASS
Band5	5MHz	QPSK	20425	25RB#0	VH	NT	-9.53	-0.011531	±2.5	PASS
Band5	5MHz	QPSK	20525	25RB#0	VL	NT	-8.15	-0.009743	±2.5	PASS
Band5	5MHz	QPSK	20525	25RB#0	VN	NT	-5.51	-0.006587	±2.5	PASS
Band5	5MHz	QPSK	20525	25RB#0	VH	NT	-1.22	-0.001458	±2.5	PASS
Band5	5MHz	QPSK	20625	25RB#0	VL	NT	-11.04	-0.013042	±2.5	PASS
Band5	5MHz	QPSK	20625	25RB#0	VN	NT	-10.21	-0.012061	±2.5	PASS
Band5	5MHz	QPSK	20625	25RB#0	VH	NT	-10.37	-0.012250	±2.5	PASS
Band5	5MHz	16QAM	20425	25RB#0	VL	NT	-11.36	-0.013745	±2.5	PASS
Band5	5MHz	16QAM	20425	25RB#0	VN	NT	-8.58	-0.010381	±2.5	PASS
Band5	5MHz	16QAM	20425	25RB#0	VH	NT	-13.70	-0.016576	±2.5	PASS
Band5	5MHz	16QAM	20525	25RB#0	VL	NT	-4.52	-0.005403	±2.5	PASS
Band5	5MHz	16QAM	20525	25RB#0	VN	NT	-12.27	-0.014668	±2.5	PASS
Band5	5MHz	16QAM	20525	25RB#0	VH	NT	-9.38	-0.011213	±2.5	PASS
Band5	5MHz	16QAM	20625	25RB#0	VL	NT	-11.72	-0.013845	±2.5	PASS
Band5	5MHz	16QAM	20625	25RB#0	VN	NT	-12.42	-0.014672	±2.5	PASS
Band5	5MHz	16QAM	20625	25RB#0	VH	NT	-11.12	-0.013136	±2.5	PASS
Band5	10MHz	QPSK	20450	50RB#0	VL	NT	-12.04	-0.014524	±2.5	PASS
Band5	10MHz	QPSK	20450	50RB#0	VN	NT	-11.54	-0.013920	±2.5	PASS
Band5	10MHz	QPSK	20450	50RB#0	VH	NT	-13.45	-0.016224	±2.5	PASS
Band5	10MHz	QPSK	20525	50RB#0	VL	NT	-10.06	-0.012026	±2.5	PASS
Band5	10MHz	QPSK	20525	50RB#0	VN	NT	3.52	0.004208	±2.5	PASS
Band5	10MHz	QPSK	20525	50RB#0	VH	NT	-7.72	-0.009229	±2.5	PASS
Band5	10MHz	QPSK	20600	50RB#0	VL	NT	-3.76	-0.004455	±2.5	PASS
Band5	10MHz	QPSK	20600	50RB#0	VN	NT	-11.72	-0.013886	±2.5	PASS
Band5	10MHz	QPSK	20600	50RB#0	VH	NT	-10.63	-0.012595	±2.5	PASS
Band5	10MHz	16QAM	20450	50RB#0	VL	NT	-5.41	-0.006526	±2.5	PASS
Band5	10MHz	16QAM	20450	50RB#0	VN	NT	-9.67	-0.011665	±2.5	PASS
Band5	10MHz	16QAM	20450	50RB#0	VH	NT	-13.15	-0.015862	±2.5	PASS
Band5	10MHz	16QAM	20525	50RB#0	VL	NT	-9.80	-0.011715	±2.5	PASS
Band5	10MHz	16QAM	20525	50RB#0	VN	NT	-4.26	-0.005093	±2.5	PASS
Band5	10MHz	16QAM	20525	50RB#0	VH	NT	-8.37	-0.010006	±2.5	PASS
Band5	10MHz	16QAM	20600	50RB#0	VL	NT	-14.32	-0.016967	±2.5	PASS
Band5	10MHz	16QAM	20600	50RB#0	VN	NT	-8.04	-0.009526	±2.5	PASS
Band5	10MHz	16QAM	20600	50RB#0	VH	NT	-12.35	-0.014633	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com

Appendix G: Frequency stability VS Temperature

Test Result

Temperature										
Band	Bandwidth	Modulation	Channel	RB Configure	Voltage [Vdc]	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
Band5	1.4MHz	QPSK	20407	6RB#0	NV	-30	-16.42	-0.019910	±2.5	PASS
Band5	1.4MHz	QPSK	20407	6RB#0	NV	-20	7.94	0.009628	±2.5	PASS
Band5	1.4MHz	QPSK	20407	6RB#0	NV	0	-11.39	-0.013811	±2.5	PASS
Band5	1.4MHz	QPSK	20407	6RB#0	NV	10	-14.15	-0.017158	±2.5	PASS
Band5	1.4MHz	QPSK	20407	6RB#0	NV	20	-10.44	-0.012659	±2.5	PASS
Band5	1.4MHz	QPSK	20525	6RB#0	NV	-30	-7.97	-0.009528	±2.5	PASS
Band5	1.4MHz	QPSK	20525	6RB#0	NV	-20	10.44	0.012481	±2.5	PASS
Band5	1.4MHz	QPSK	20525	6RB#0	NV	0	-6.57	-0.007854	±2.5	PASS
Band5	1.4MHz	QPSK	20525	6RB#0	NV	10	-8.10	-0.009683	±2.5	PASS
Band5	1.4MHz	QPSK	20525	6RB#0	NV	20	-8.78	-0.010496	±2.5	PASS
Band5	1.4MHz	QPSK	20643	6RB#0	NV	-30	-8.83	-0.010409	±2.5	PASS
Band5	1.4MHz	QPSK	20643	6RB#0	NV	-20	-9.58	-0.011293	±2.5	PASS
Band5	1.4MHz	QPSK	20643	6RB#0	NV	0	-11.90	-0.014028	±2.5	PASS
Band5	1.4MHz	QPSK	20643	6RB#0	NV	10	-8.70	-0.010256	±2.5	PASS
Band5	1.4MHz	QPSK	20643	6RB#0	NV	20	-6.55	-0.007721	±2.5	PASS
Band5	1.4MHz	16QAM	20407	6RB#0	NV	-30	-7.60	-0.009215	±2.5	PASS
Band5	1.4MHz	16QAM	20407	6RB#0	NV	-20	-10.89	-0.013205	±2.5	PASS
Band5	1.4MHz	16QAM	20407	6RB#0	NV	0	-8.15	-0.009882	±2.5	PASS
Band5	1.4MHz	16QAM	20407	6RB#0	NV	10	-10.23	-0.012405	±2.5	PASS
Band5	1.4MHz	16QAM	20407	6RB#0	NV	20	-8.43	-0.010222	±2.5	PASS
Band5	1.4MHz	16QAM	20525	6RB#0	NV	-30	-7.78	-0.009301	±2.5	PASS
Band5	1.4MHz	16QAM	20525	6RB#0	NV	-20	-11.47	-0.013712	±2.5	PASS
Band5	1.4MHz	16QAM	20525	6RB#0	NV	0	-4.13	-0.004937	±2.5	PASS
Band5	1.4MHz	16QAM	20525	6RB#0	NV	10	-7.35	-0.008787	±2.5	PASS
Band5	1.4MHz	16QAM	20525	6RB#0	NV	20	-7.58	-0.009062	±2.5	PASS
Band5	1.4MHz	16QAM	20643	6RB#0	NV	-30	-3.10	-0.003654	±2.5	PASS
Band5	1.4MHz	16QAM	20643	6RB#0	NV	-20	-7.35	-0.008664	±2.5	PASS
Band5	1.4MHz	16QAM	20643	6RB#0	NV	0	-5.16	-0.006083	±2.5	PASS
Band5	1.4MHz	16QAM	20643	6RB#0	NV	10	-2.30	-0.002711	±2.5	PASS
Band5	1.4MHz	16QAM	20643	6RB#0	NV	20	-10.96	-0.012920	±2.5	PASS
Band5	3MHz	QPSK	20415	15RB#0	NV	-30	-2.92	-0.003537	±2.5	PASS
Band5	3MHz	QPSK	20415	15RB#0	NV	-20	-2.70	-0.003271	±2.5	PASS
Band5	3MHz	QPSK	20415	15RB#0	NV	0	-3.75	-0.004543	±2.5	PASS

Band5	3MHz	QPSK	20415	15RB#0	NV	10	-2.35	-0.002847	±2.5	PASS
Band5	3MHz	QPSK	20415	15RB#0	NV	20	-2.40	-0.002907	±2.5	PASS
Band5	3MHz	QPSK	20525	15RB#0	NV	-30	-3.32	-0.003969	±2.5	PASS
Band5	3MHz	QPSK	20525	15RB#0	NV	-20	-1.76	-0.002104	±2.5	PASS
Band5	3MHz	QPSK	20525	15RB#0	NV	0	-3.71	-0.004435	±2.5	PASS
Band5	3MHz	QPSK	20525	15RB#0	NV	10	-3.40	-0.004065	±2.5	PASS
Band5	3MHz	QPSK	20525	15RB#0	NV	20	-4.58	-0.005475	±2.5	PASS
Band5	3MHz	QPSK	20635	15RB#0	NV	-30	-3.76	-0.004437	±2.5	PASS
Band5	3MHz	QPSK	20635	15RB#0	NV	-20	-3.86	-0.004555	±2.5	PASS
Band5	3MHz	QPSK	20635	15RB#0	NV	0	-5.79	-0.006832	±2.5	PASS
Band5	3MHz	QPSK	20635	15RB#0	NV	10	-3.48	-0.004106	±2.5	PASS
Band5	3MHz	QPSK	20635	15RB#0	NV	20	-4.36	-0.005145	±2.5	PASS
Band5	3MHz	16QAM	20415	15RB#0	NV	-30	-2.22	-0.002689	±2.5	PASS
Band5	3MHz	16QAM	20415	15RB#0	NV	-20	-2.05	-0.002483	±2.5	PASS
Band5	3MHz	16QAM	20415	15RB#0	NV	0	-5.25	-0.006360	±2.5	PASS
Band5	3MHz	16QAM	20415	15RB#0	NV	10	-2.15	-0.002604	±2.5	PASS
Band5	3MHz	16QAM	20415	15RB#0	NV	20	-3.13	-0.003792	±2.5	PASS
Band5	3MHz	16QAM	20525	15RB#0	NV	-30	-3.76	-0.004495	±2.5	PASS
Band5	3MHz	16QAM	20525	15RB#0	NV	-20	-3.02	-0.003610	±2.5	PASS
Band5	3MHz	16QAM	20525	15RB#0	NV	0	-3.66	-0.004375	±2.5	PASS
Band5	3MHz	16QAM	20525	15RB#0	NV	10	-3.46	-0.004136	±2.5	PASS
Band5	3MHz	16QAM	20525	15RB#0	NV	20	-2.53	-0.003025	±2.5	PASS
Band5	3MHz	16QAM	20635	15RB#0	NV	-30	-3.25	-0.003835	±2.5	PASS
Band5	3MHz	16QAM	20635	15RB#0	NV	-20	-5.75	-0.006785	±2.5	PASS
Band5	3MHz	16QAM	20635	15RB#0	NV	0	-3.98	-0.004696	±2.5	PASS
Band5	3MHz	16QAM	20635	15RB#0	NV	10	-4.11	-0.004850	±2.5	PASS
Band5	3MHz	16QAM	20635	15RB#0	NV	20	-3.42	-0.004035	±2.5	PASS
Band5	5MHz	QPSK	20425	25RB#0	NV	-30	-12.25	-0.014822	±2.5	PASS
Band5	5MHz	QPSK	20425	25RB#0	NV	-20	-11.60	-0.014035	±2.5	PASS
Band5	5MHz	QPSK	20425	25RB#0	NV	0	-4.02	-0.004864	±2.5	PASS
Band5	5MHz	QPSK	20425	25RB#0	NV	10	-4.86	-0.005880	±2.5	PASS
Band5	5MHz	QPSK	20425	25RB#0	NV	20	-7.74	-0.009365	±2.5	PASS
Band5	5MHz	QPSK	20525	25RB#0	NV	-30	-10.04	-0.012002	±2.5	PASS
Band5	5MHz	QPSK	20525	25RB#0	NV	-20	-5.82	-0.006958	±2.5	PASS
Band5	5MHz	QPSK	20525	25RB#0	NV	0	-5.16	-0.006169	±2.5	PASS
Band5	5MHz	QPSK	20525	25RB#0	NV	10	-5.65	-0.006754	±2.5	PASS
Band5	5MHz	QPSK	20525	25RB#0	NV	20	-6.77	-0.008093	±2.5	PASS
Band5	5MHz	QPSK	20625	25RB#0	NV	-30	-12.40	-0.014649	±2.5	PASS
Band5	5MHz	QPSK	20625	25RB#0	NV	-20	-6.64	-0.007844	±2.5	PASS
Band5	5MHz	QPSK	20625	25RB#0	NV	0	-12.04	-0.014223	±2.5	PASS

Band5	5MHz	QPSK	20625	25RB#0	NV	10	-8.50	-0.010041	±2.5	PASS
Band5	5MHz	QPSK	20625	25RB#0	NV	20	-5.36	-0.006332	±2.5	PASS
Band5	5MHz	16QAM	20425	25RB#0	NV	-30	-5.71	-0.006909	±2.5	PASS
Band5	5MHz	16QAM	20425	25RB#0	NV	-20	-4.22	-0.005106	±2.5	PASS
Band5	5MHz	16QAM	20425	25RB#0	NV	0	-4.56	-0.005517	±2.5	PASS
Band5	5MHz	16QAM	20425	25RB#0	NV	10	-8.08	-0.009776	±2.5	PASS
Band5	5MHz	16QAM	20425	25RB#0	NV	20	-8.64	-0.010454	±2.5	PASS
Band5	5MHz	16QAM	20525	25RB#0	NV	-30	-10.60	-0.012672	±2.5	PASS
Band5	5MHz	16QAM	20525	25RB#0	NV	-20	-12.66	-0.015134	±2.5	PASS
Band5	5MHz	16QAM	20525	25RB#0	NV	0	-7.51	-0.008978	±2.5	PASS
Band5	5MHz	16QAM	20525	25RB#0	NV	10	-10.69	-0.012779	±2.5	PASS
Band5	5MHz	16QAM	20525	25RB#0	NV	20	-11.80	-0.014106	±2.5	PASS
Band5	5MHz	16QAM	20625	25RB#0	NV	-30	-12.69	-0.014991	±2.5	PASS
Band5	5MHz	16QAM	20625	25RB#0	NV	-20	-8.63	-0.010195	±2.5	PASS
Band5	5MHz	16QAM	20625	25RB#0	NV	0	-10.54	-0.012451	±2.5	PASS
Band5	5MHz	16QAM	20625	25RB#0	NV	10	-19.54	-0.023083	±2.5	PASS
Band5	5MHz	16QAM	20625	25RB#0	NV	20	-14.39	-0.016999	±2.5	PASS
Band5	10MHz	QPSK	20450	50RB#0	NV	-30	-13.68	-0.016502	±2.5	PASS
Band5	10MHz	QPSK	20450	50RB#0	NV	-20	-9.17	-0.011062	±2.5	PASS
Band5	10MHz	QPSK	20450	50RB#0	NV	0	-11.09	-0.013378	±2.5	PASS
Band5	10MHz	QPSK	20450	50RB#0	NV	10	-9.23	-0.011134	±2.5	PASS
Band5	10MHz	QPSK	20450	50RB#0	NV	20	-8.04	-0.009698	±2.5	PASS
Band5	10MHz	QPSK	20525	50RB#0	NV	-30	-12.56	-0.015015	±2.5	PASS
Band5	10MHz	QPSK	20525	50RB#0	NV	-20	-10.89	-0.013019	±2.5	PASS
Band5	10MHz	QPSK	20525	50RB#0	NV	0	-3.55	-0.004244	±2.5	PASS
Band5	10MHz	QPSK	20525	50RB#0	NV	10	-9.98	-0.011931	±2.5	PASS
Band5	10MHz	QPSK	20525	50RB#0	NV	20	-13.62	-0.016282	±2.5	PASS
Band5	10MHz	QPSK	20600	50RB#0	NV	-30	-7.93	-0.009396	±2.5	PASS
Band5	10MHz	QPSK	20600	50RB#0	NV	-20	-14.41	-0.017073	±2.5	PASS
Band5	10MHz	QPSK	20600	50RB#0	NV	0	-6.75	-0.007998	±2.5	PASS
Band5	10MHz	QPSK	20600	50RB#0	NV	10	-12.89	-0.015273	±2.5	PASS
Band5	10MHz	QPSK	20600	50RB#0	NV	20	-12.33	-0.014609	±2.5	PASS
Band5	10MHz	16QAM	20450	50RB#0	NV	-30	-14.82	-0.017877	±2.5	PASS
Band5	10MHz	16QAM	20450	50RB#0	NV	-20	-10.63	-0.012823	±2.5	PASS
Band5	10MHz	16QAM	20450	50RB#0	NV	0	-10.24	-0.012352	±2.5	PASS
Band5	10MHz	16QAM	20450	50RB#0	NV	10	-5.45	-0.006574	±2.5	PASS
Band5	10MHz	16QAM	20450	50RB#0	NV	20	-9.30	-0.011218	±2.5	PASS
Band5	10MHz	16QAM	20525	50RB#0	NV	-30	-8.23	-0.009839	±2.5	PASS
Band5	10MHz	16QAM	20525	50RB#0	NV	-20	-9.64	-0.011524	±2.5	PASS
Band5	10MHz	16QAM	20525	50RB#0	NV	0	-7.98	-0.009540	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com

Band5	10MHz	16QAM	20525	50RB#0	NV	10	-8.14	-0.009731	±2.5	PASS
Band5	10MHz	16QAM	20525	50RB#0	NV	20	-8.64	-0.010329	±2.5	PASS
Band5	10MHz	16QAM	20600	50RB#0	NV	-30	-8.01	-0.009491	±2.5	PASS
Band5	10MHz	16QAM	20600	50RB#0	NV	-20	-11.10	-0.013152	±2.5	PASS
Band5	10MHz	16QAM	20600	50RB#0	NV	0	-9.20	-0.010900	±2.5	PASS
Band5	10MHz	16QAM	20600	50RB#0	NV	10	-11.42	-0.013531	±2.5	PASS
Band5	10MHz	16QAM	20600	50RB#0	NV	20	-13.93	-0.016505	±2.5	PASS

---End---

