




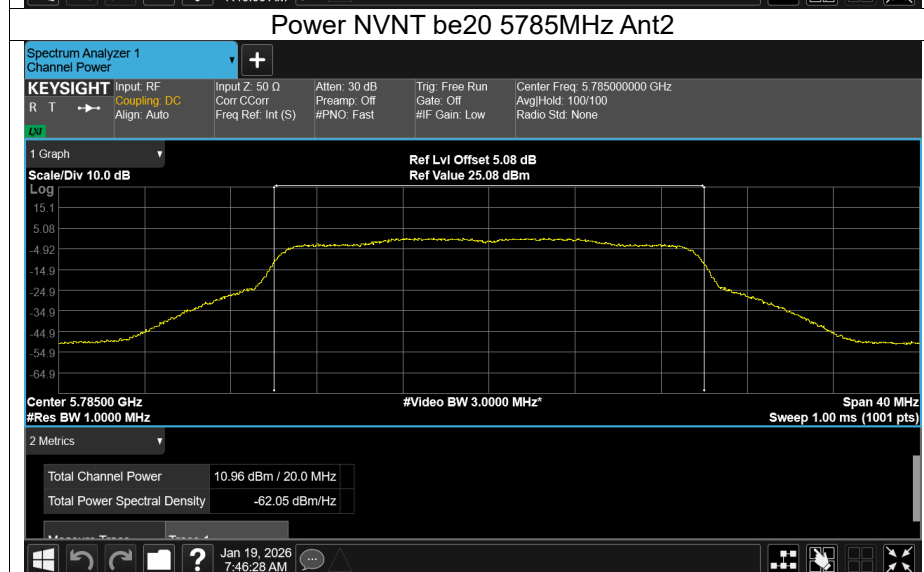
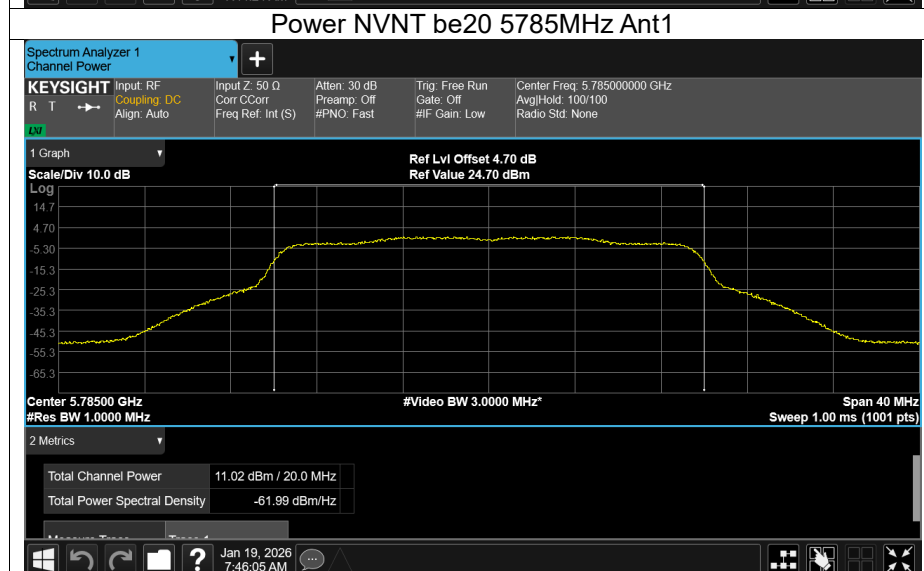
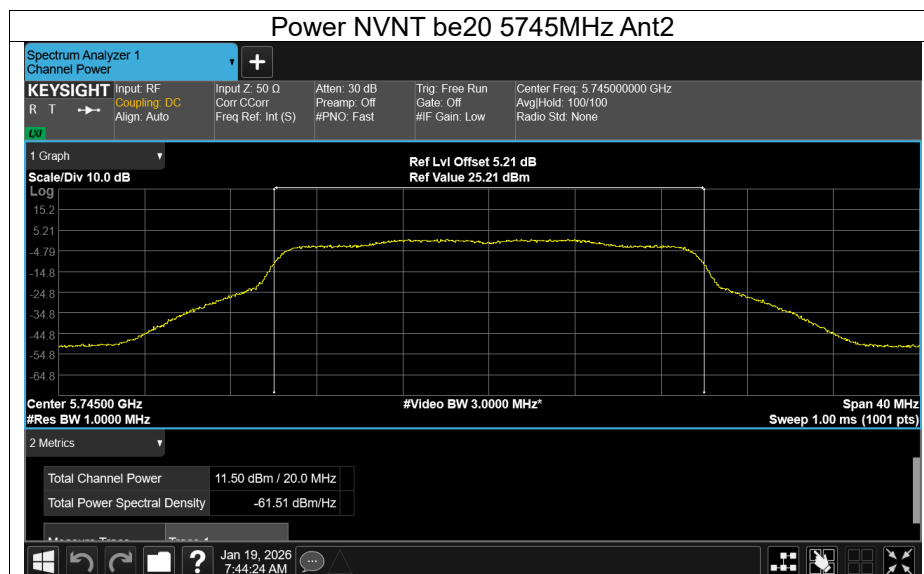
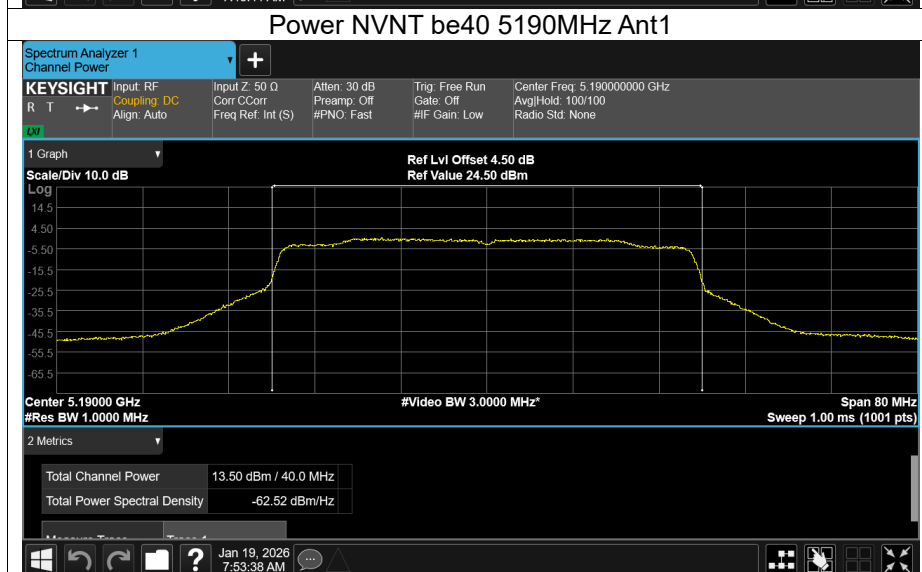
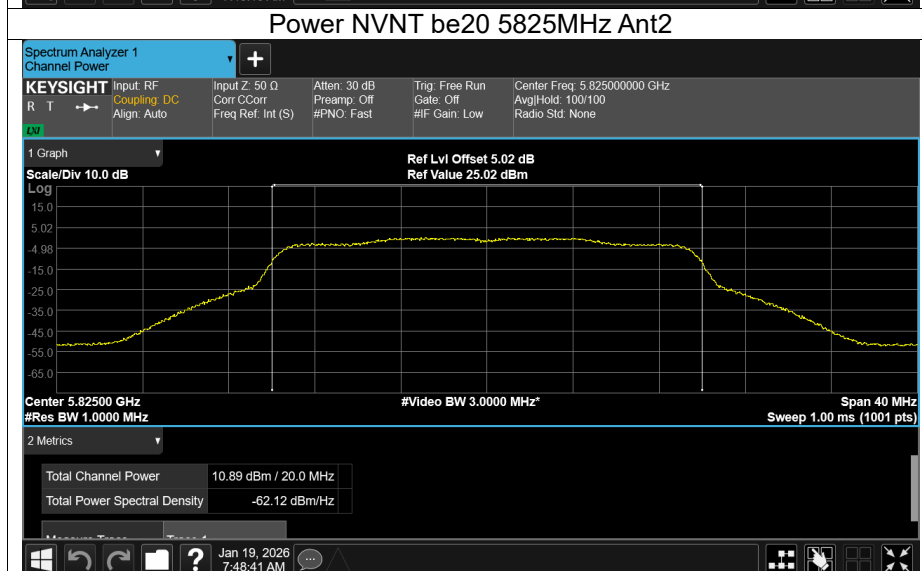
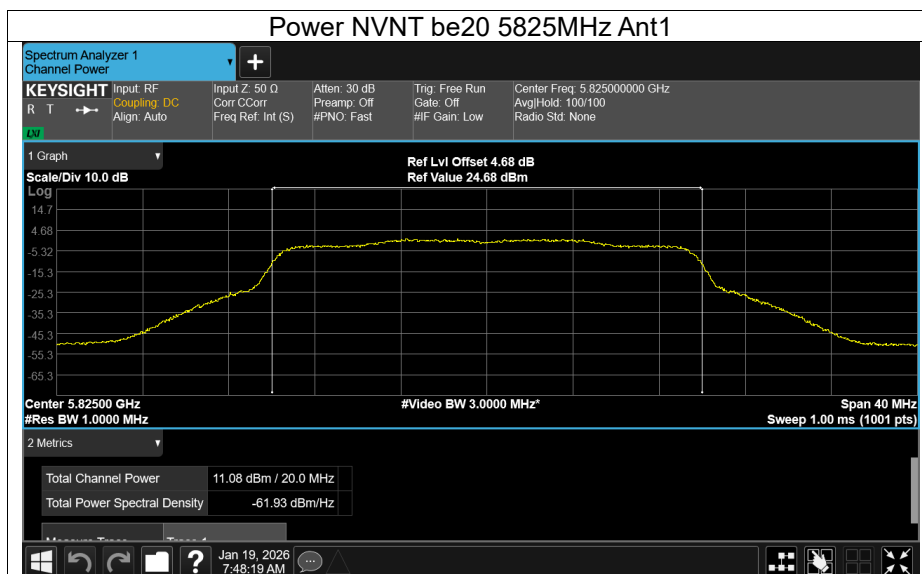
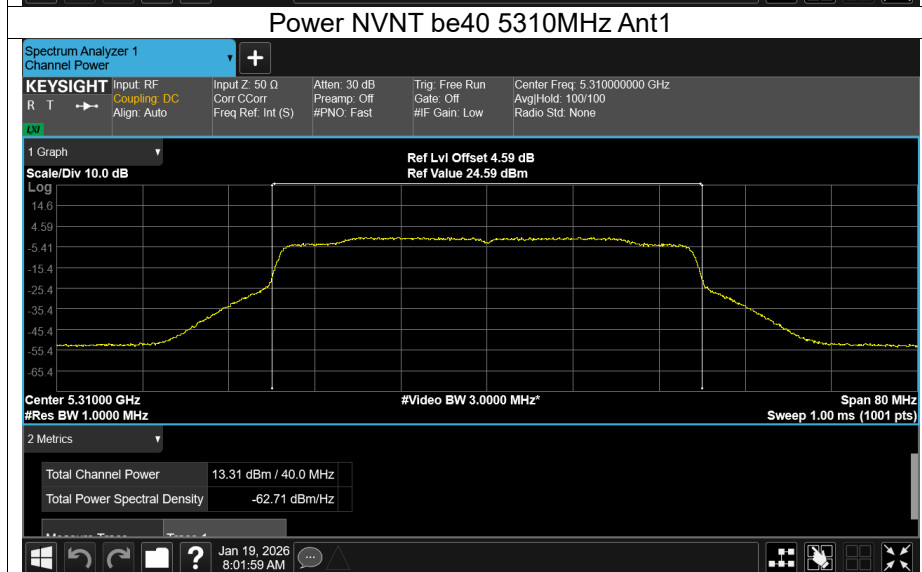
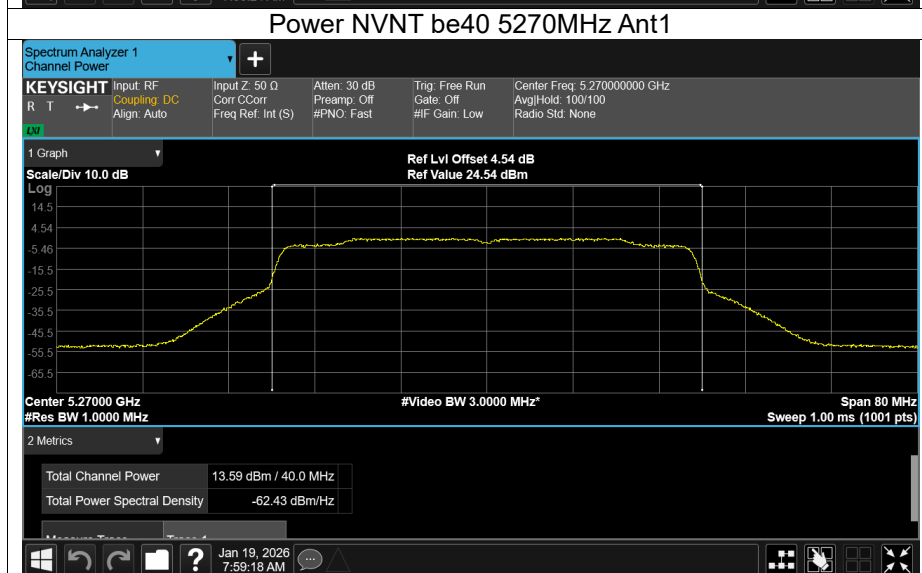
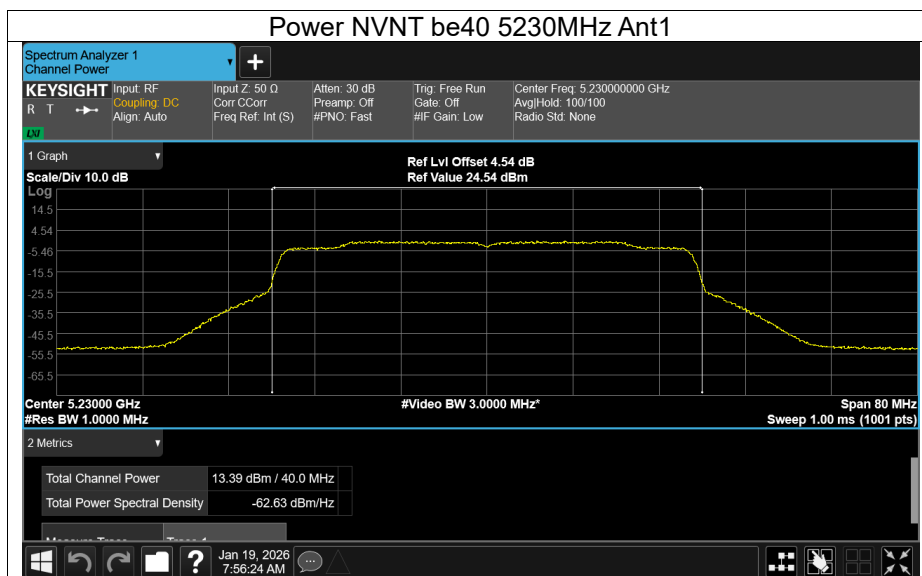
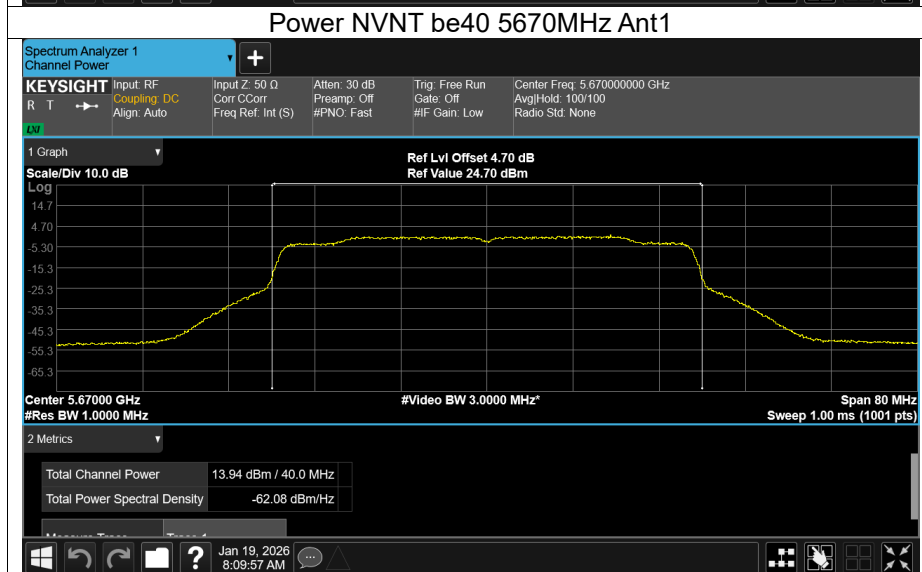




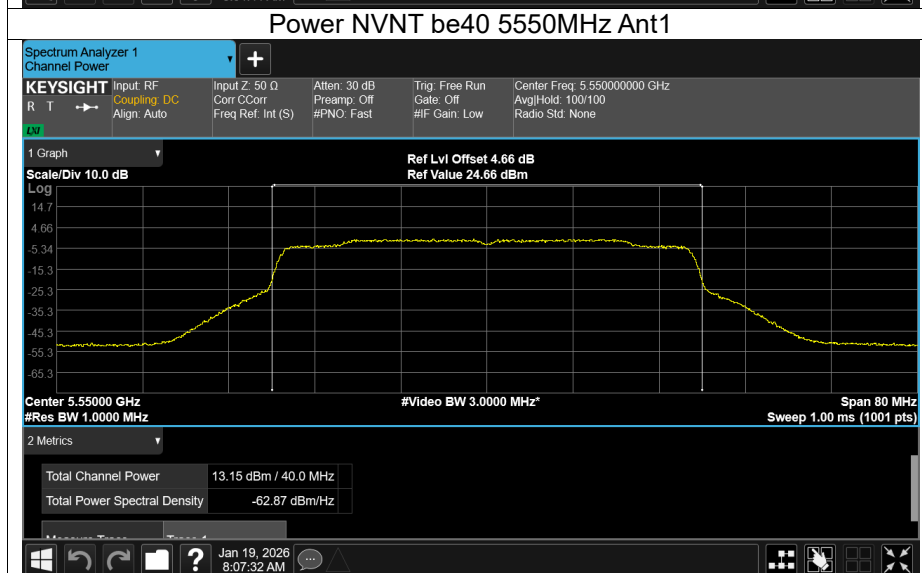




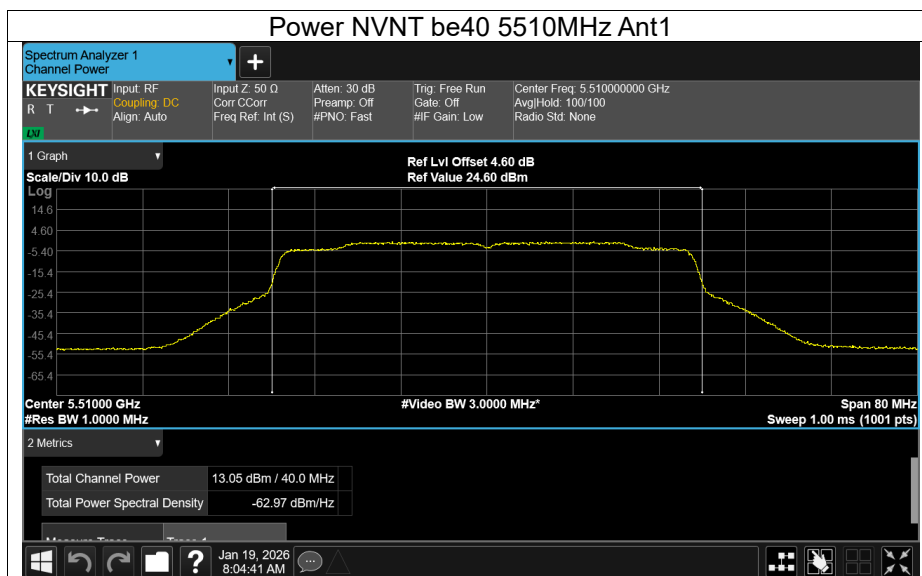




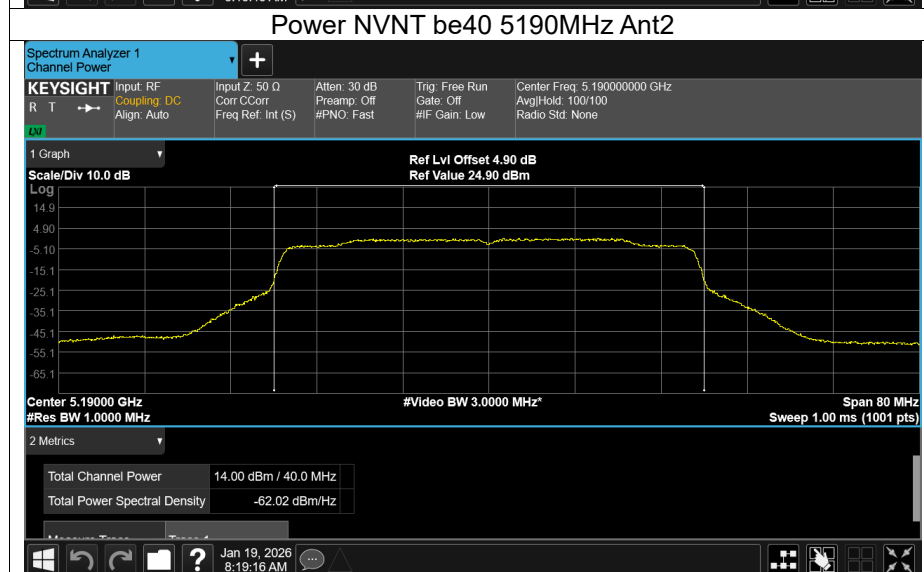




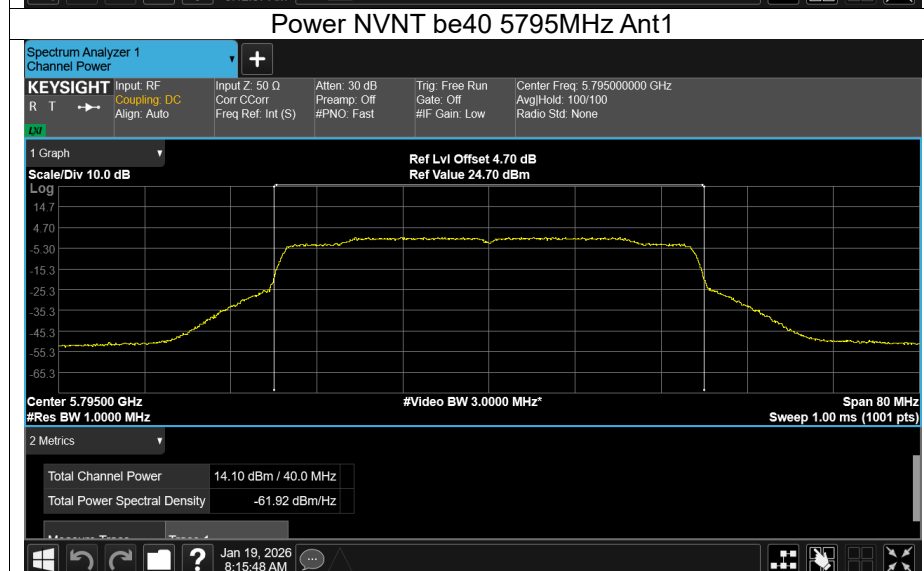




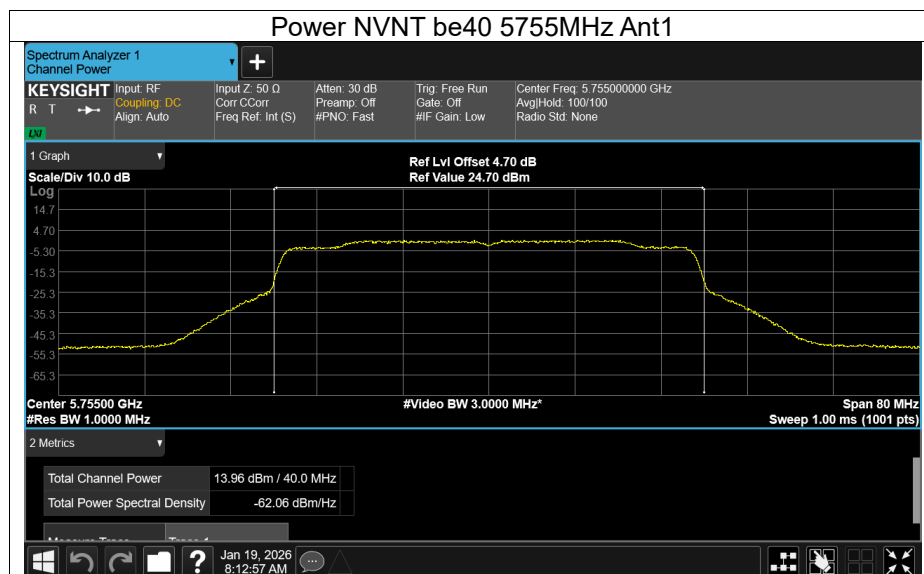


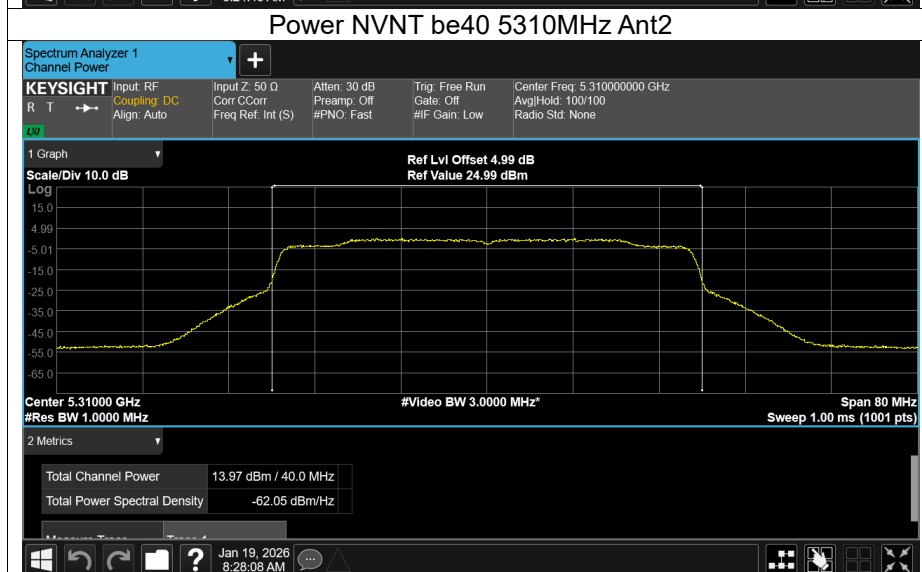
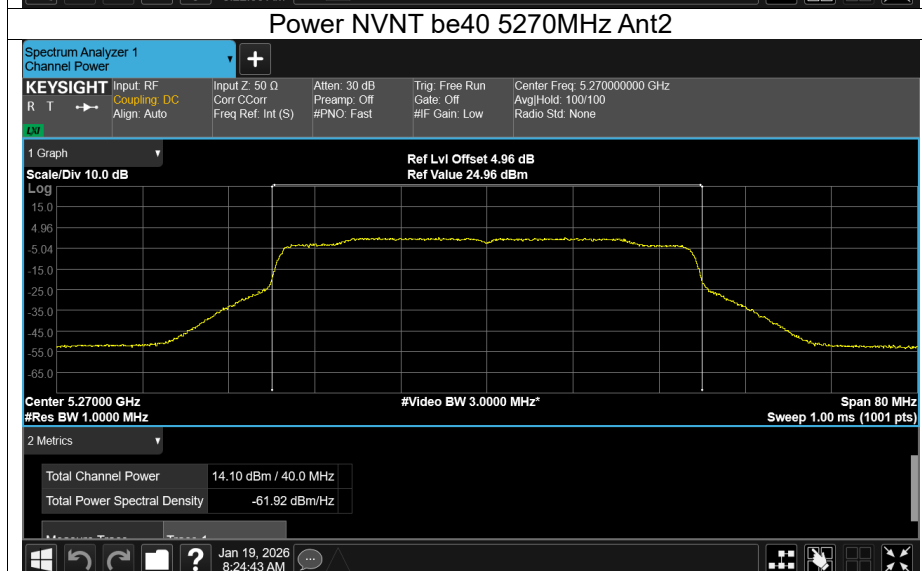
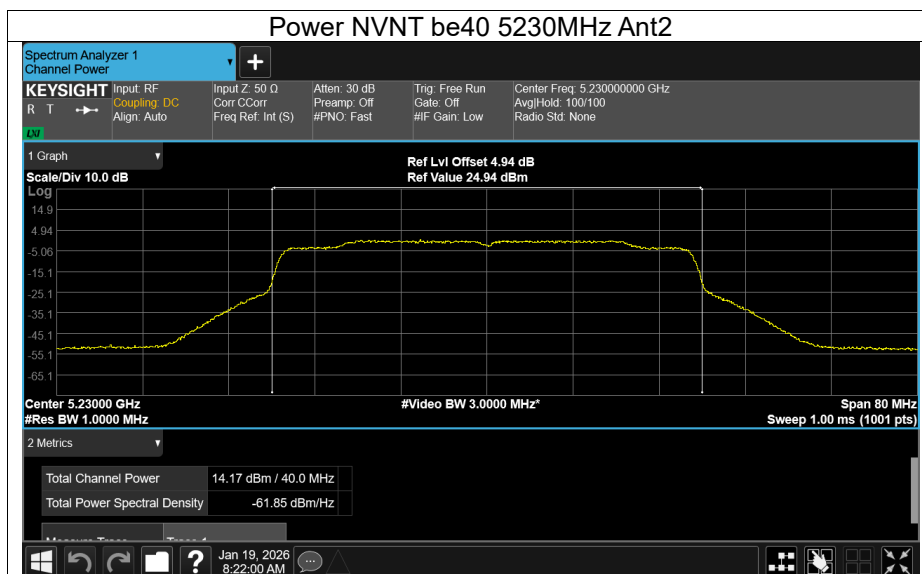


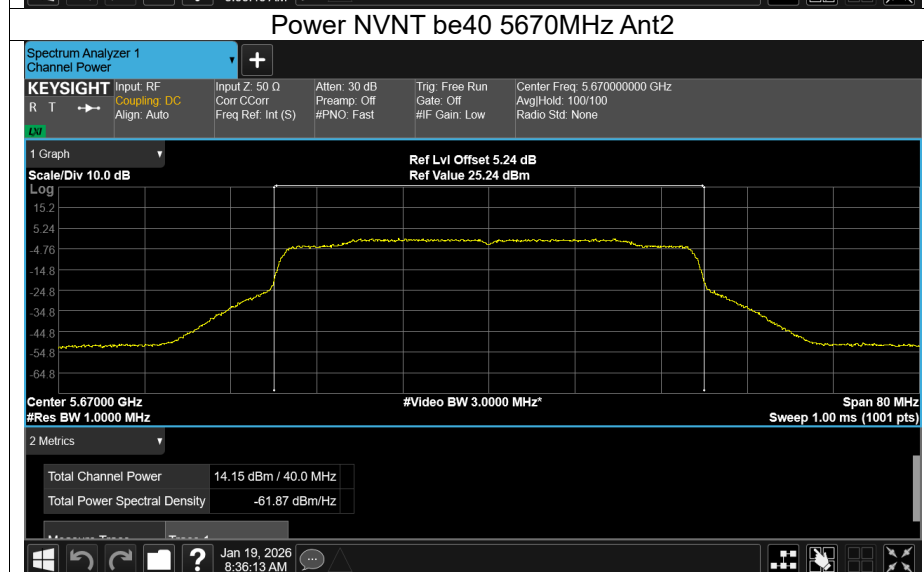
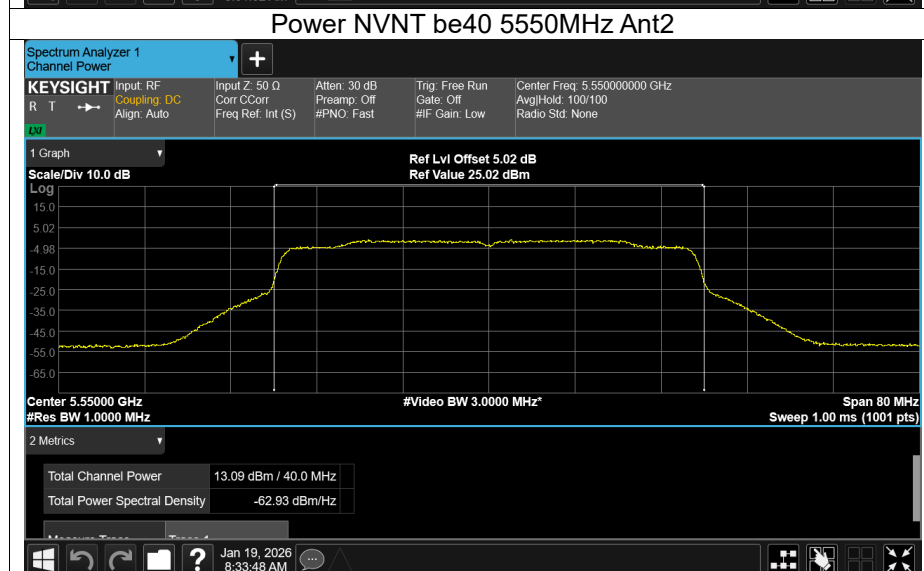
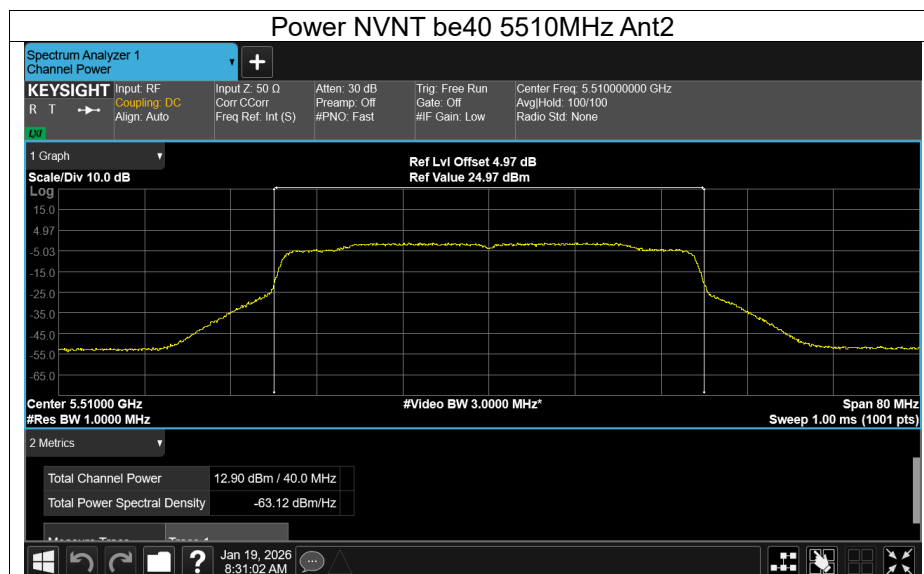


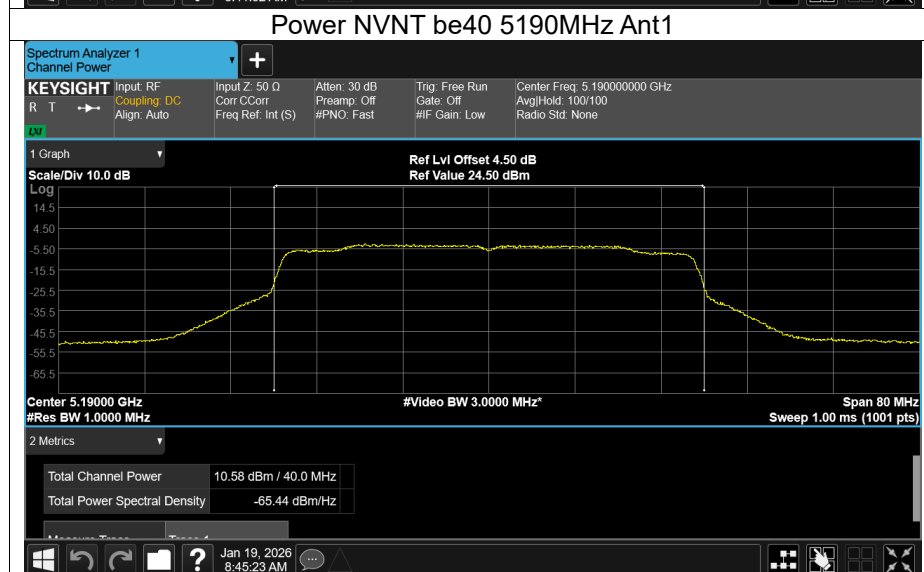
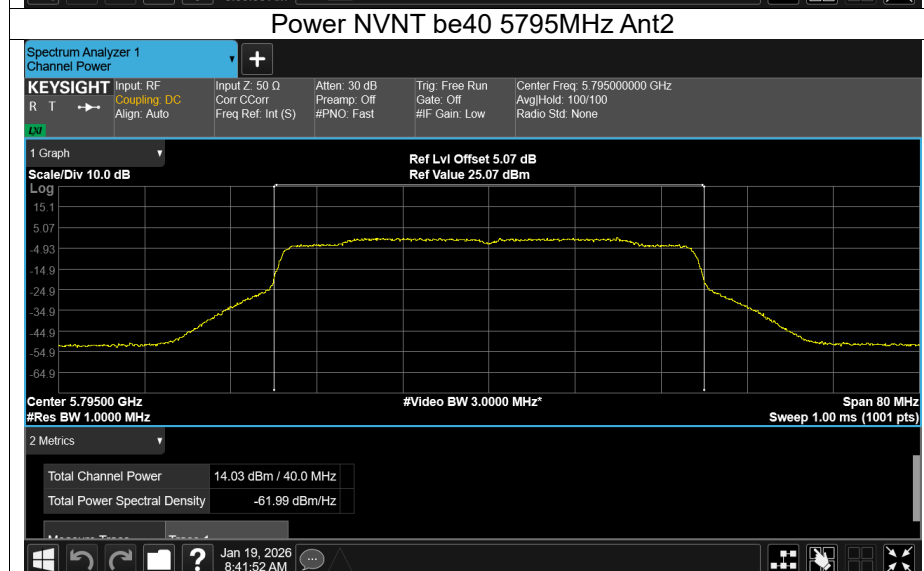
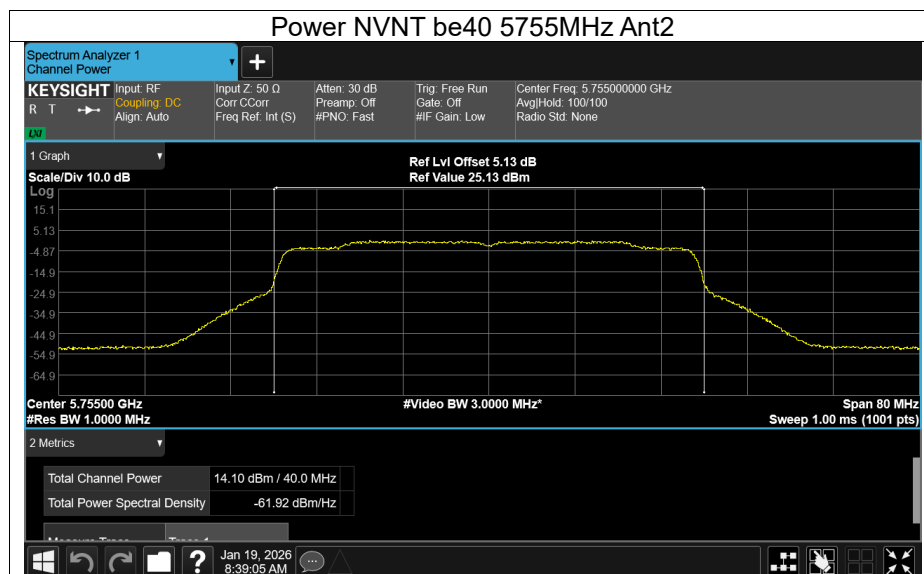


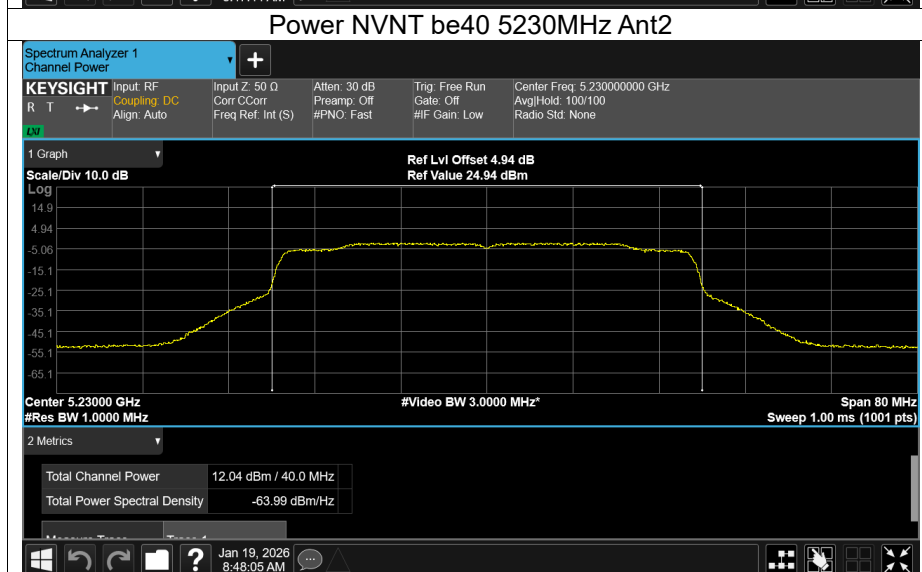
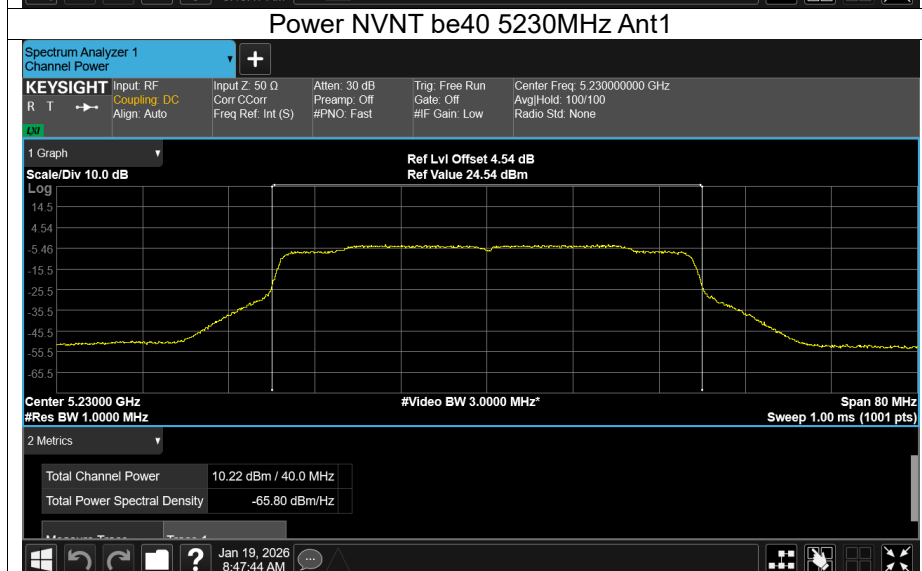
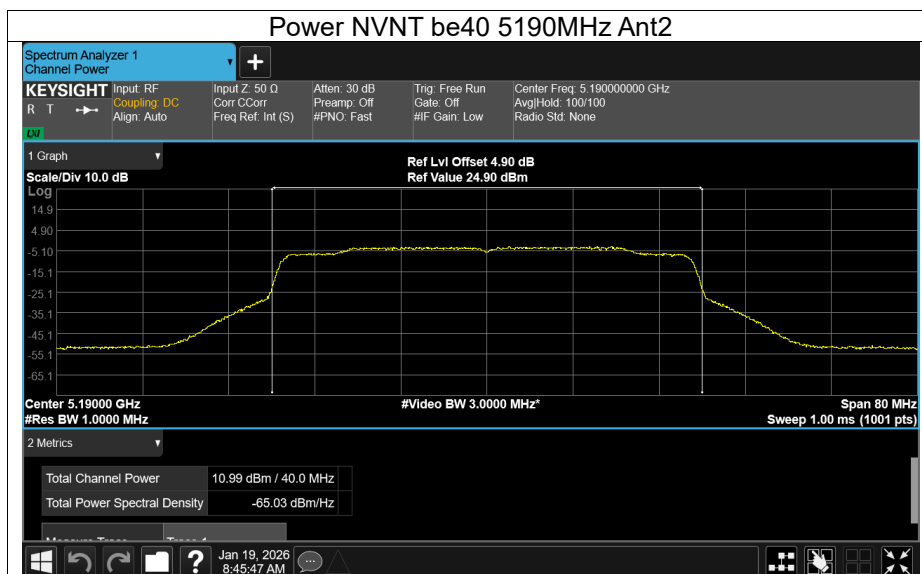


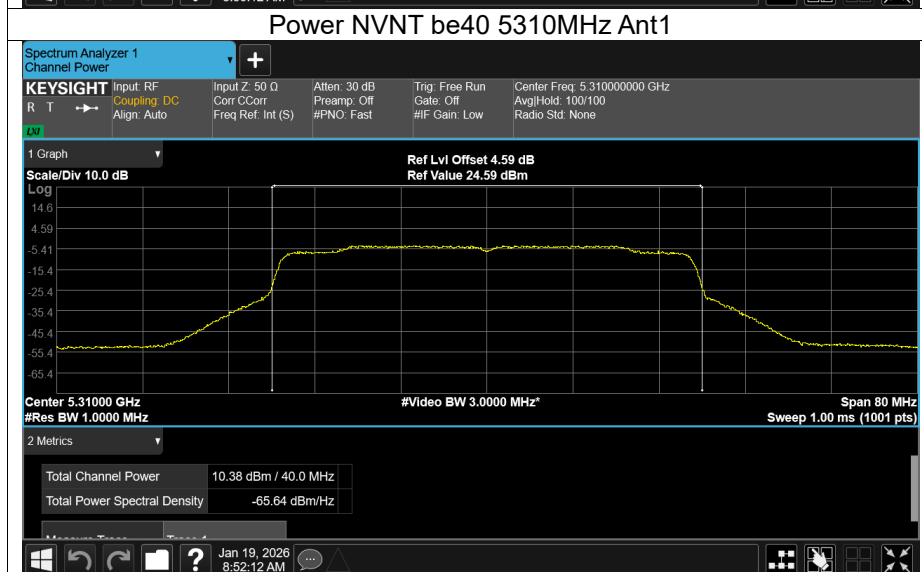
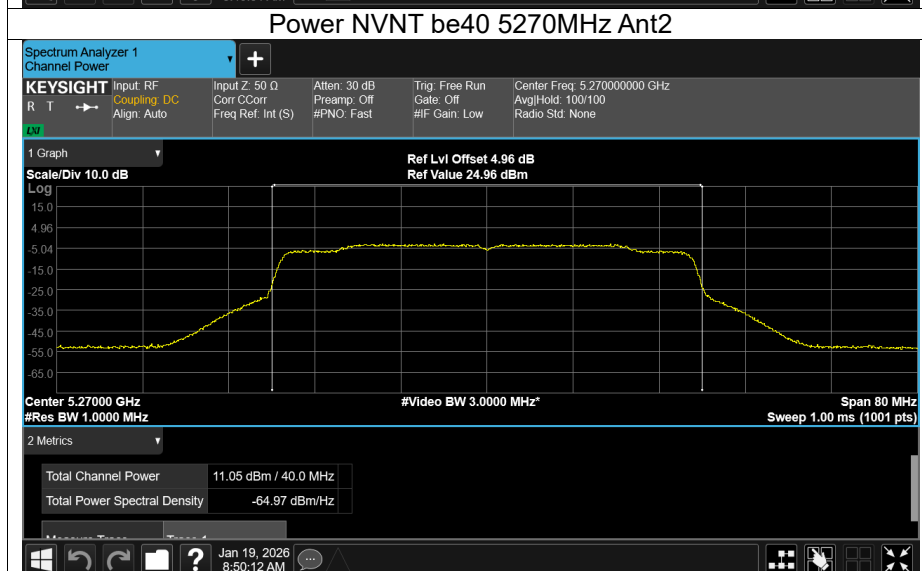
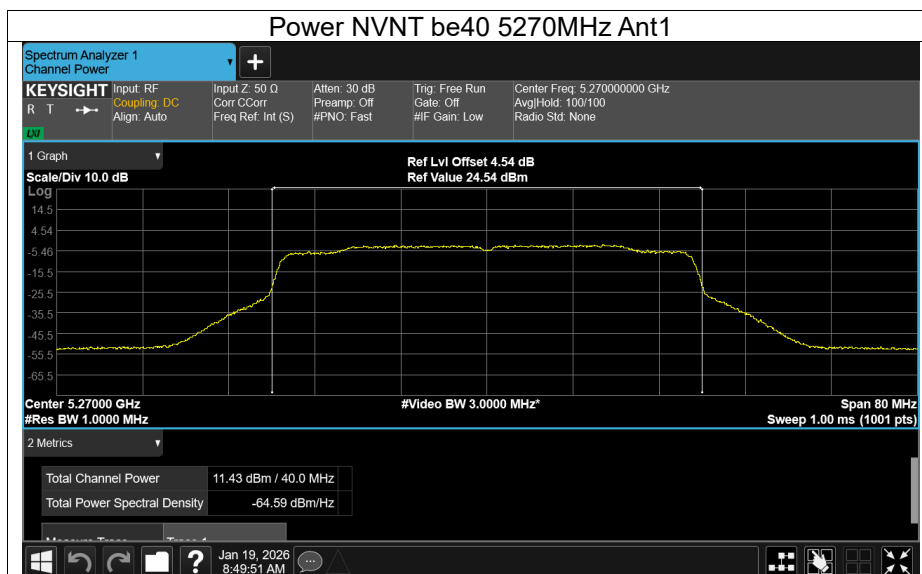


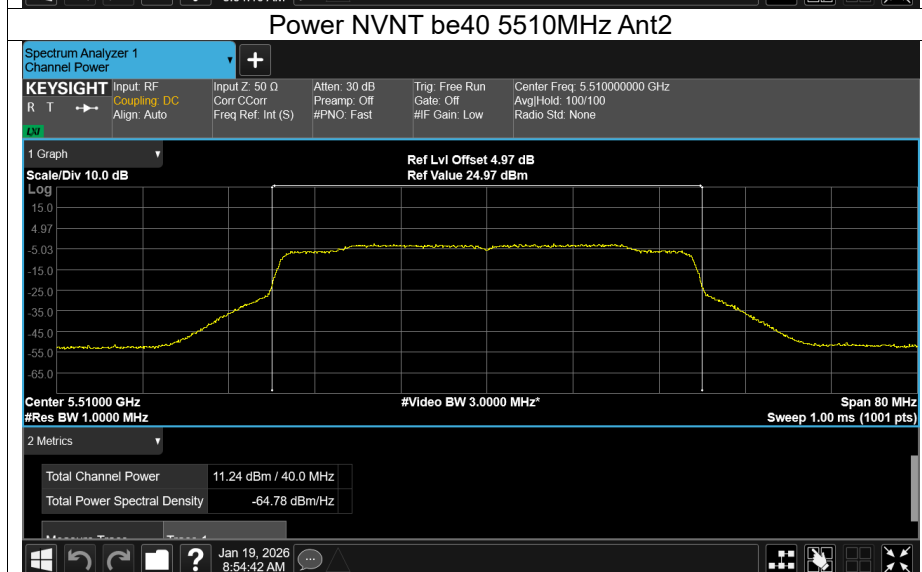
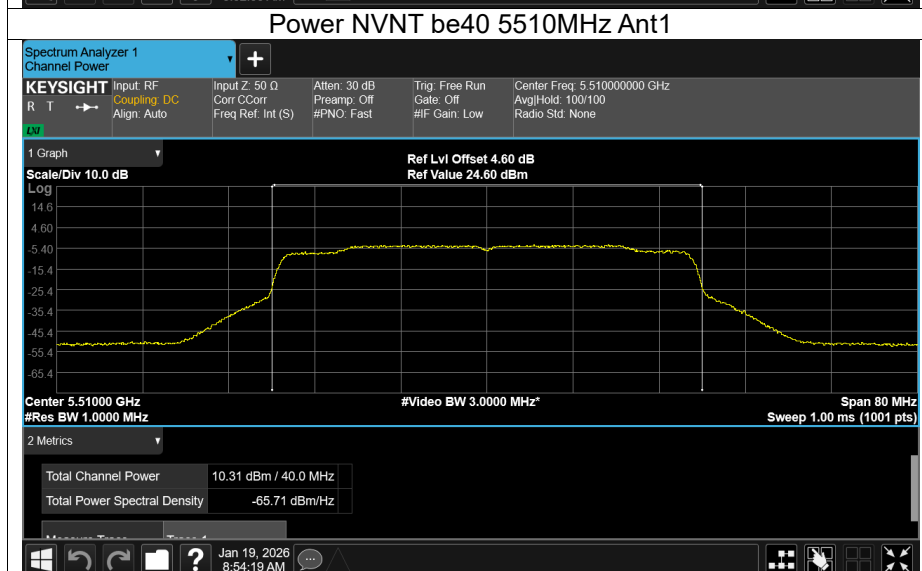
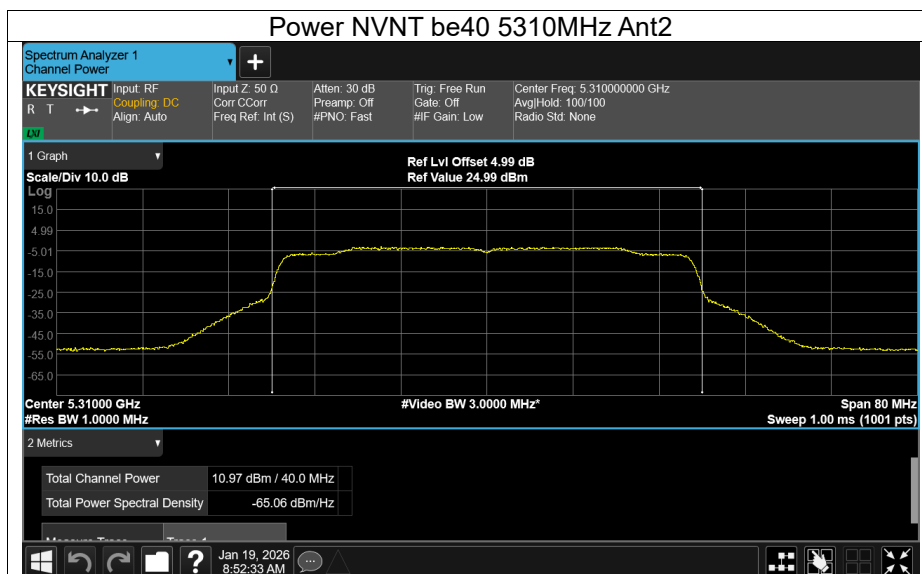


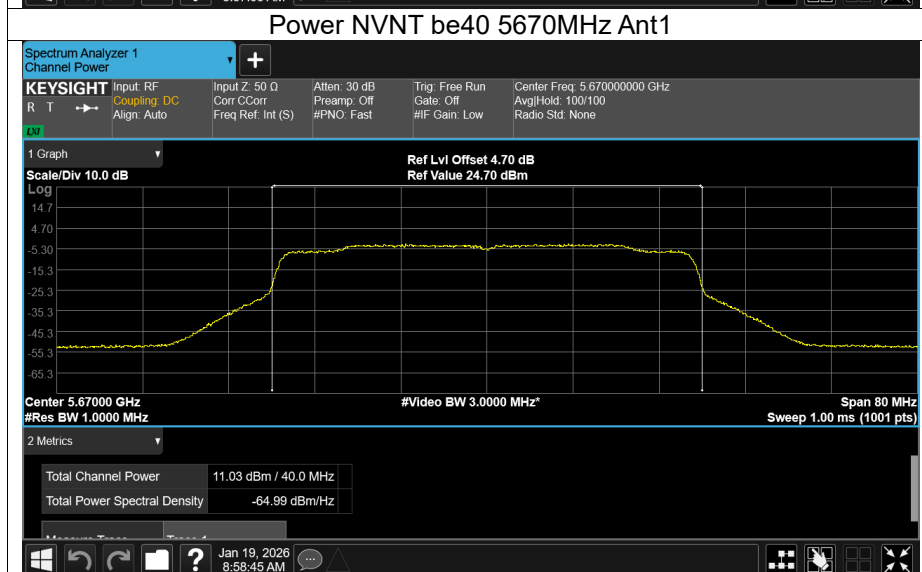
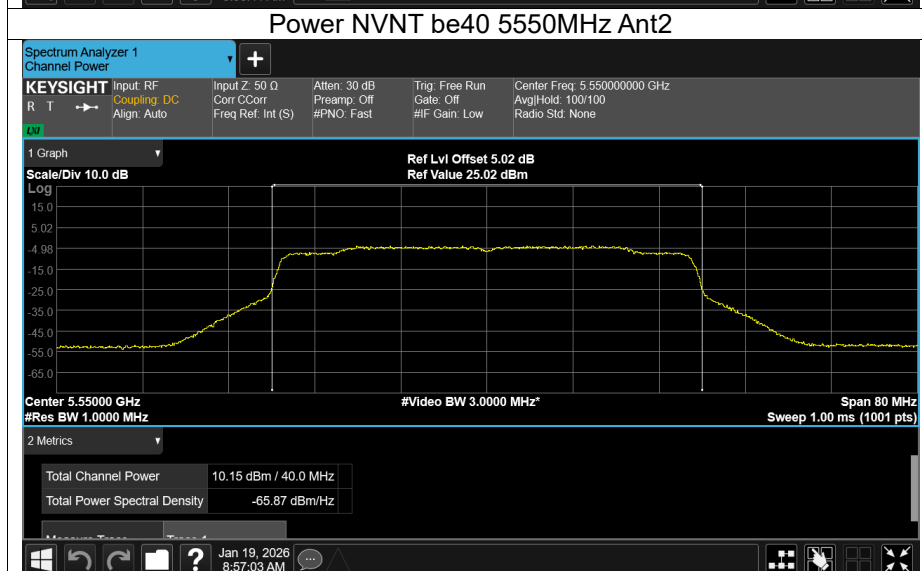
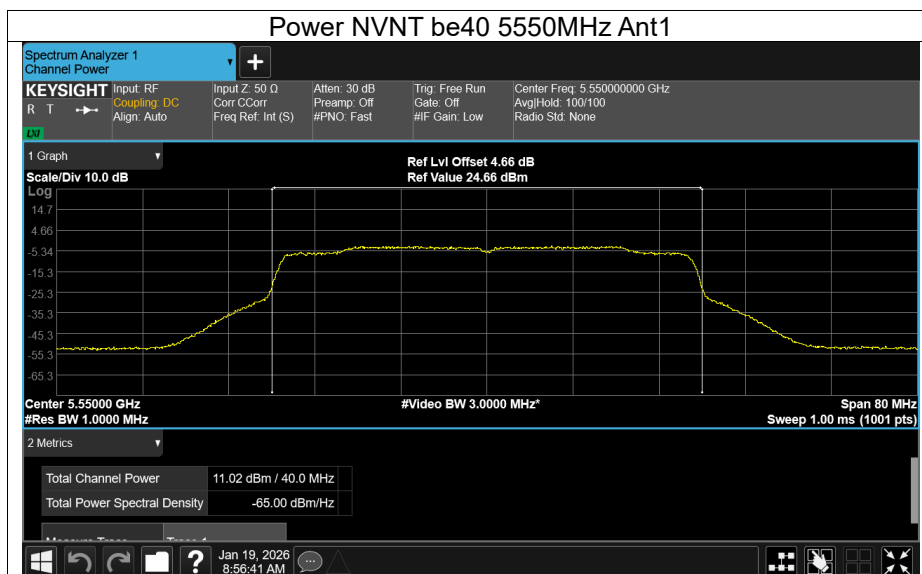


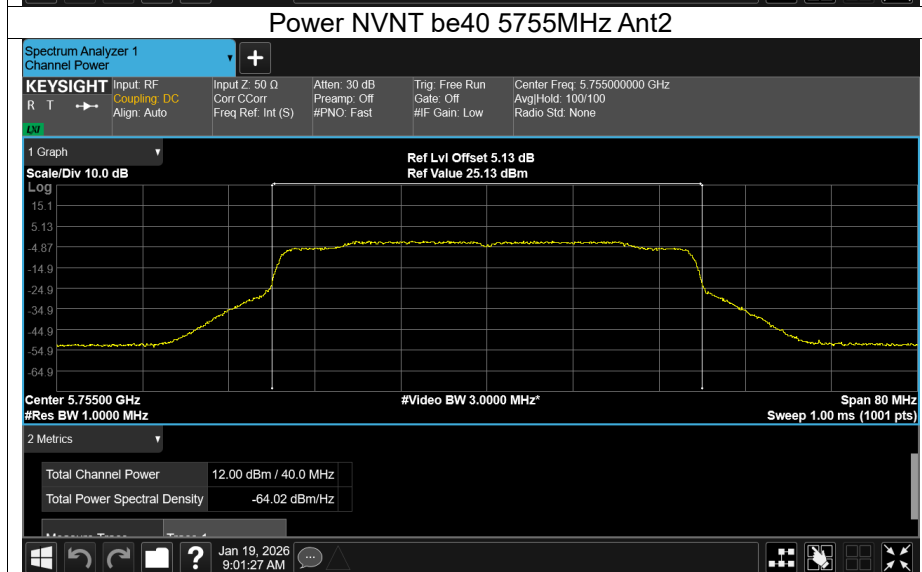
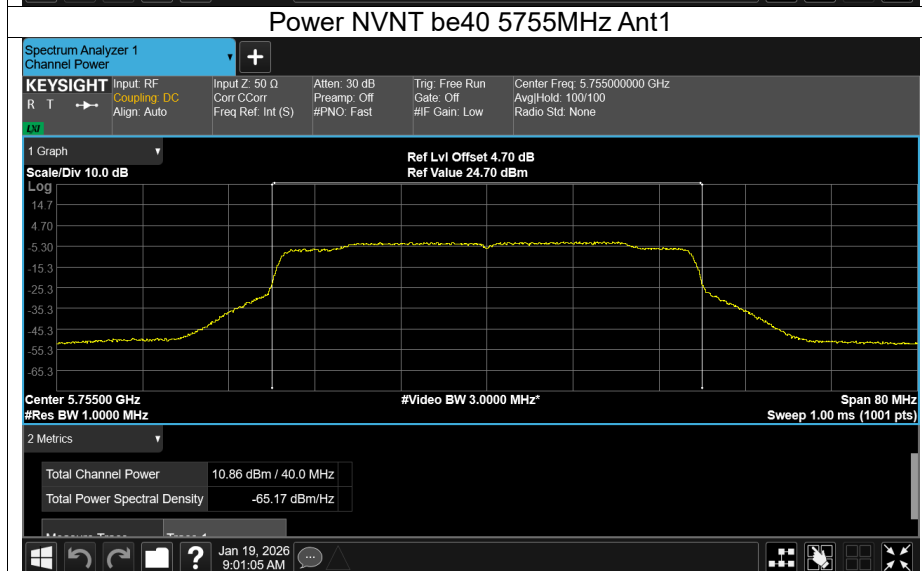
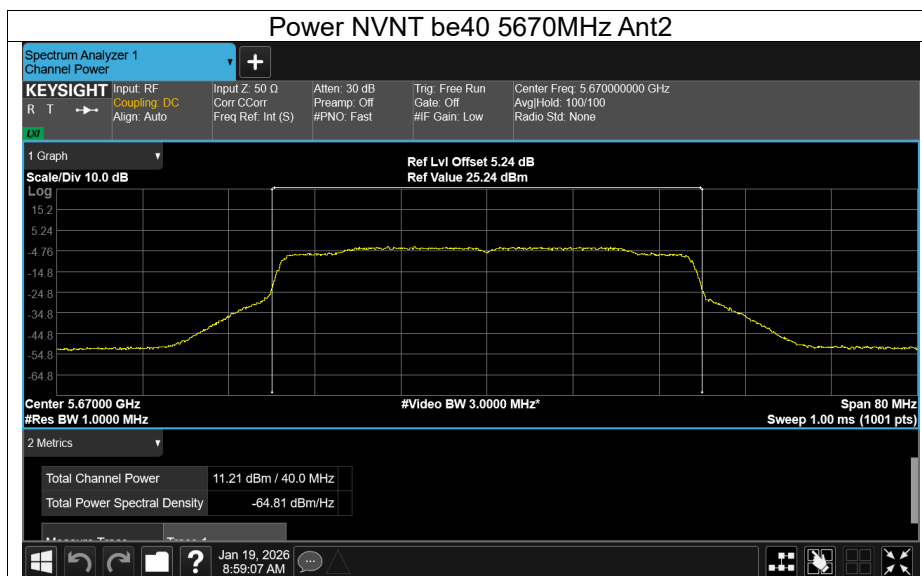


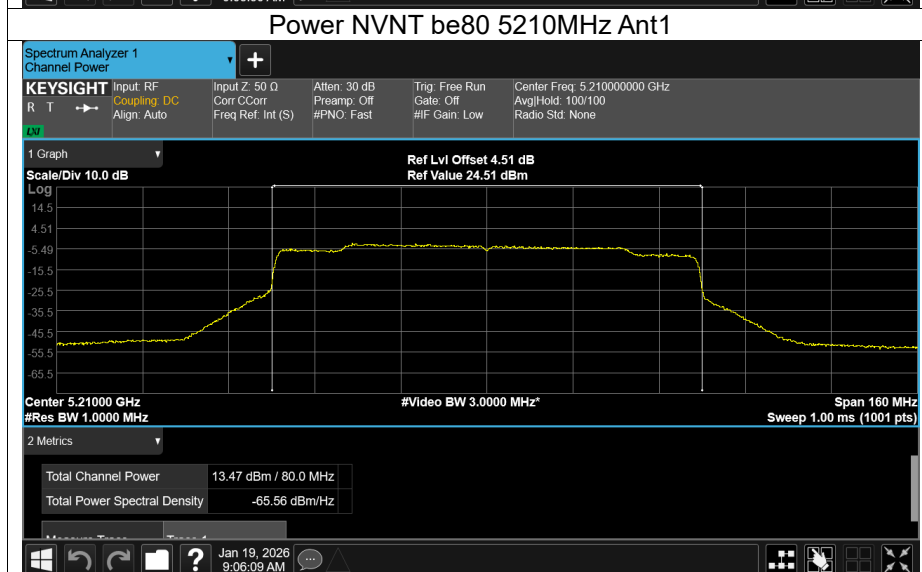
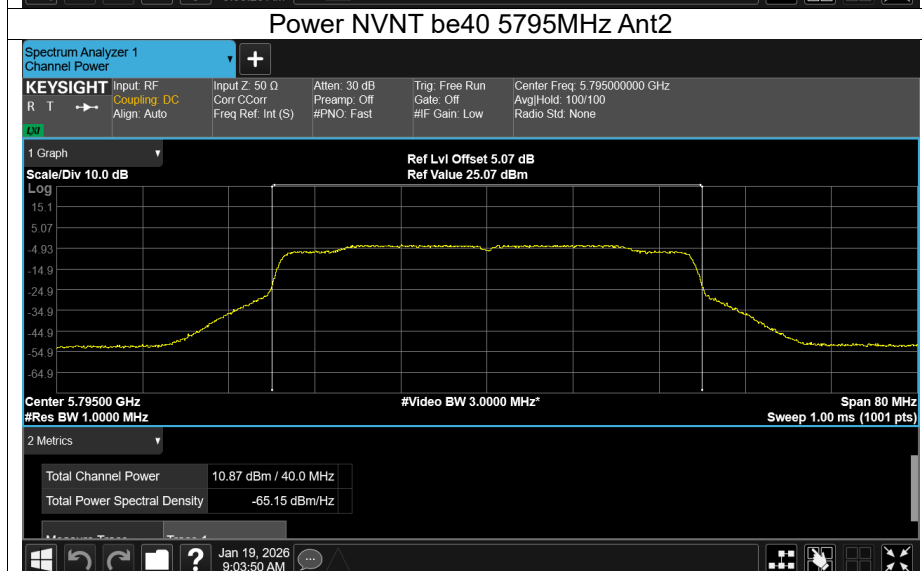
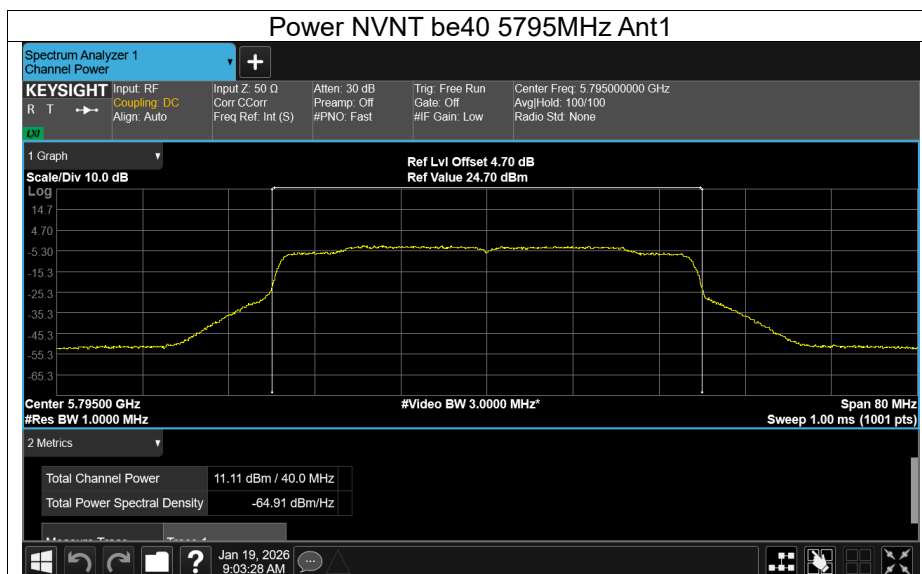


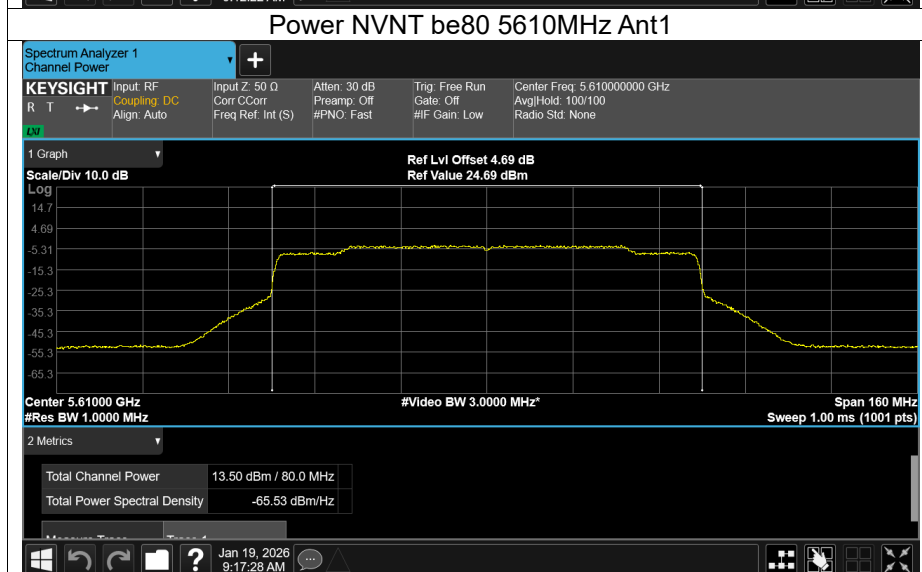
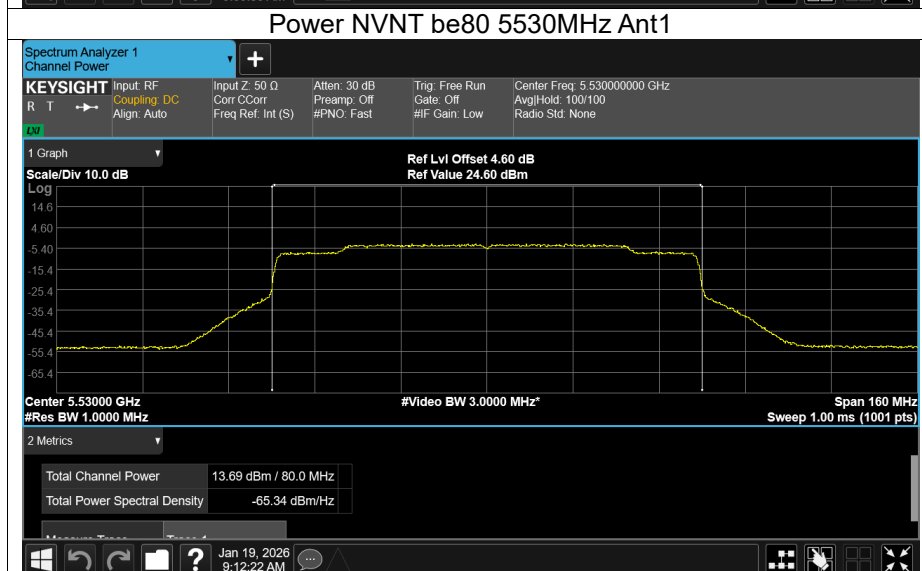
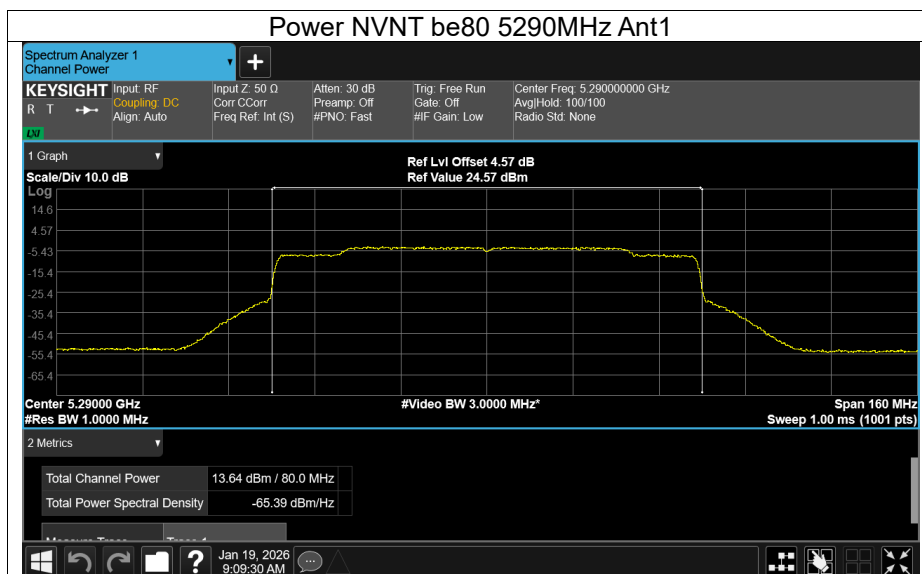


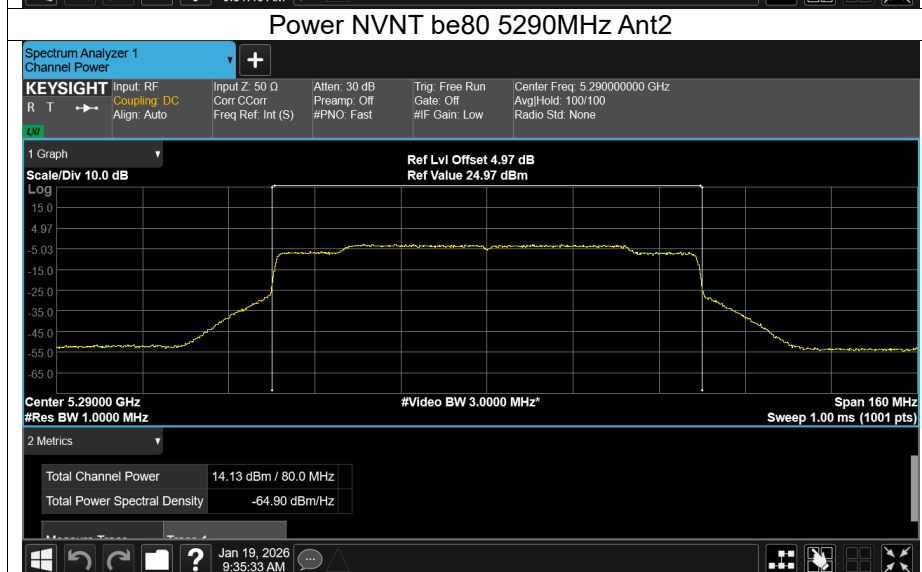
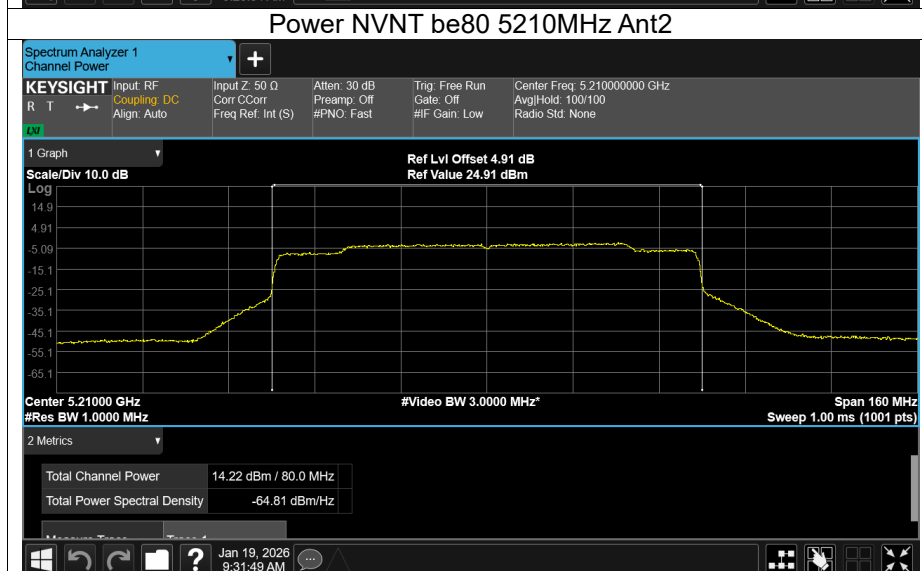
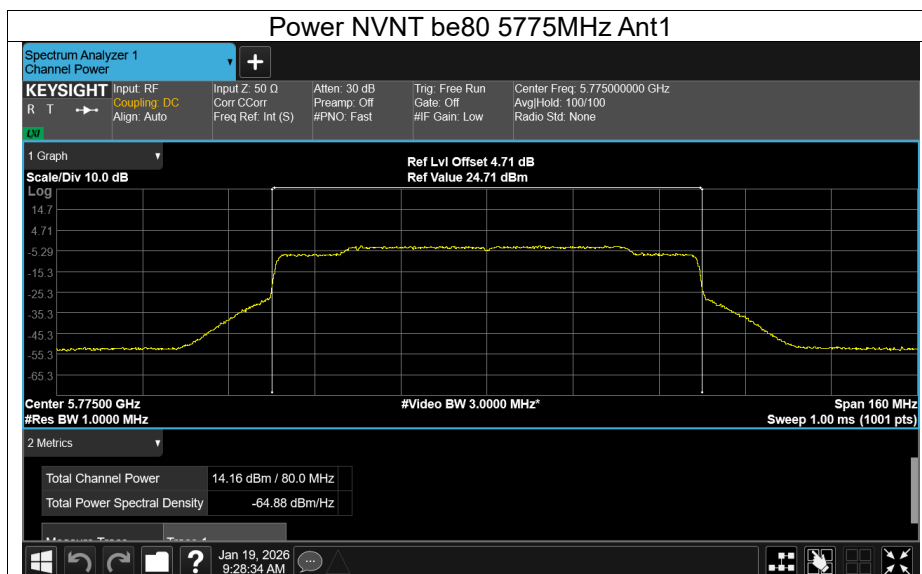


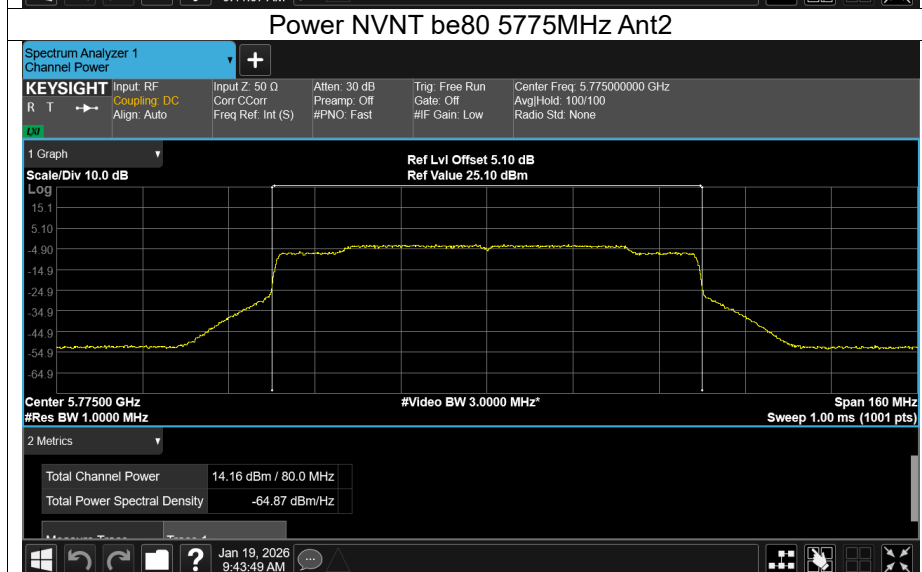
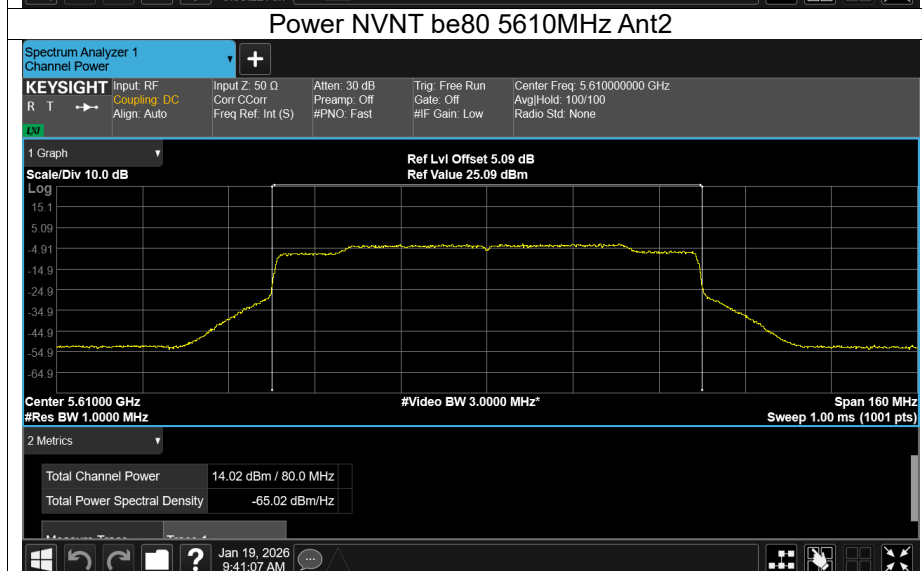
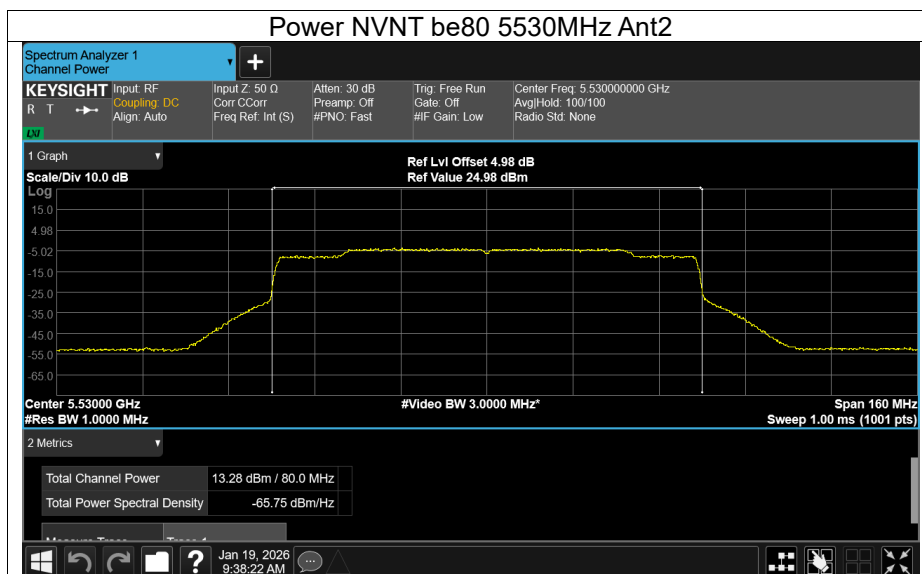


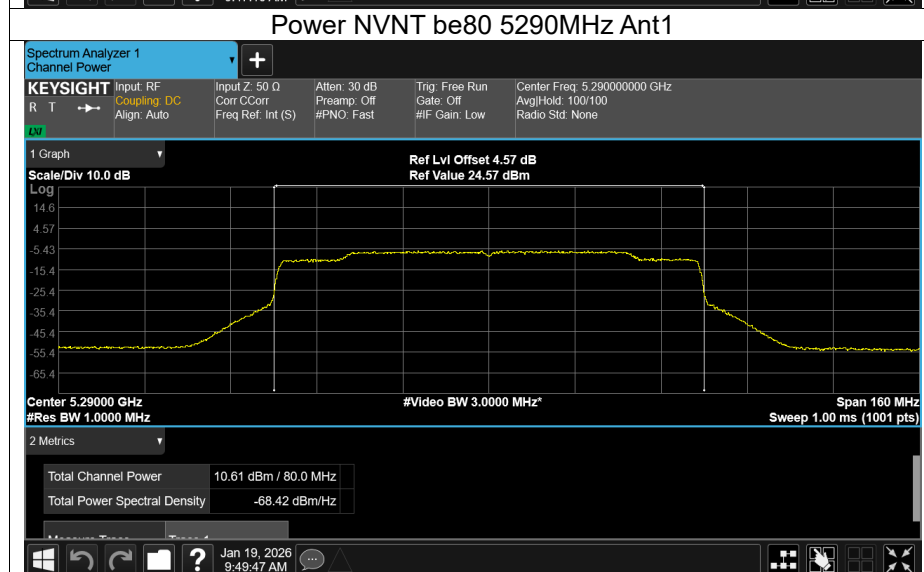
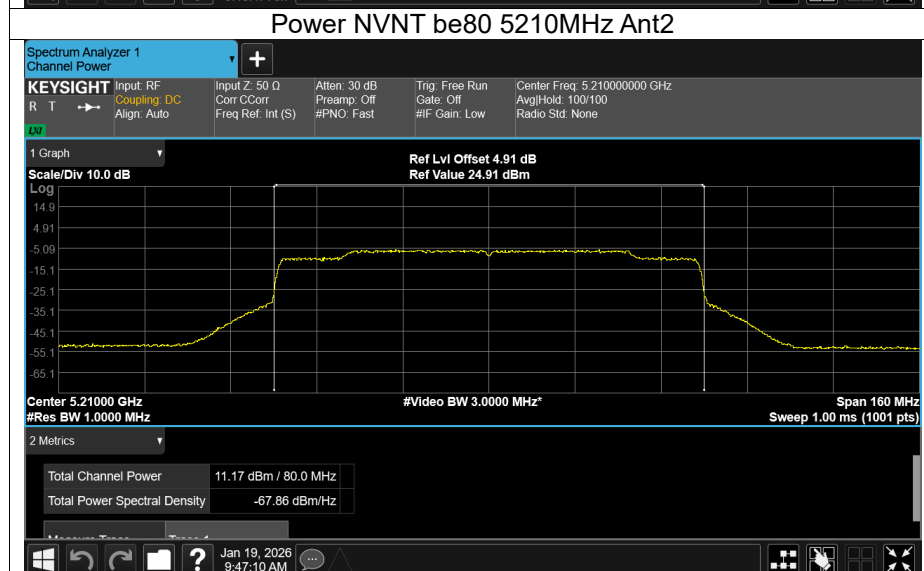
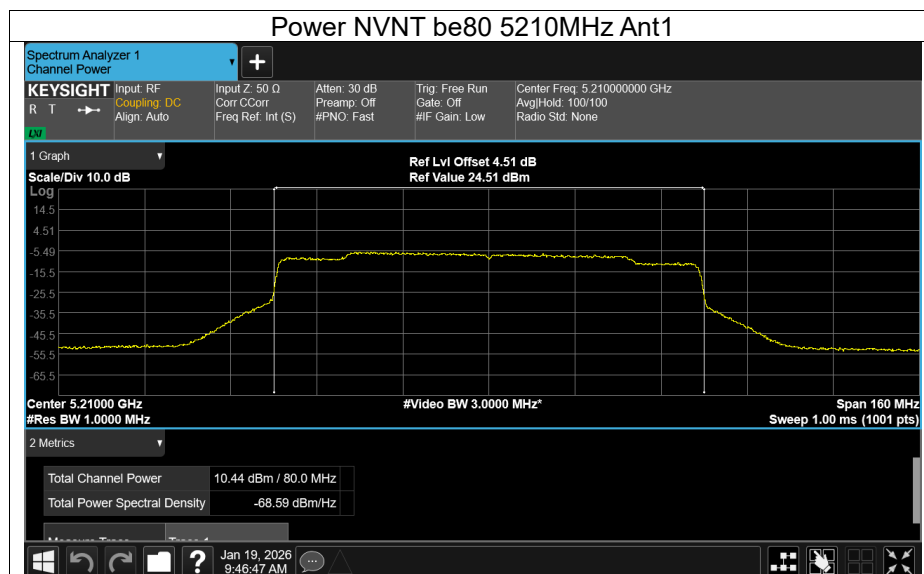


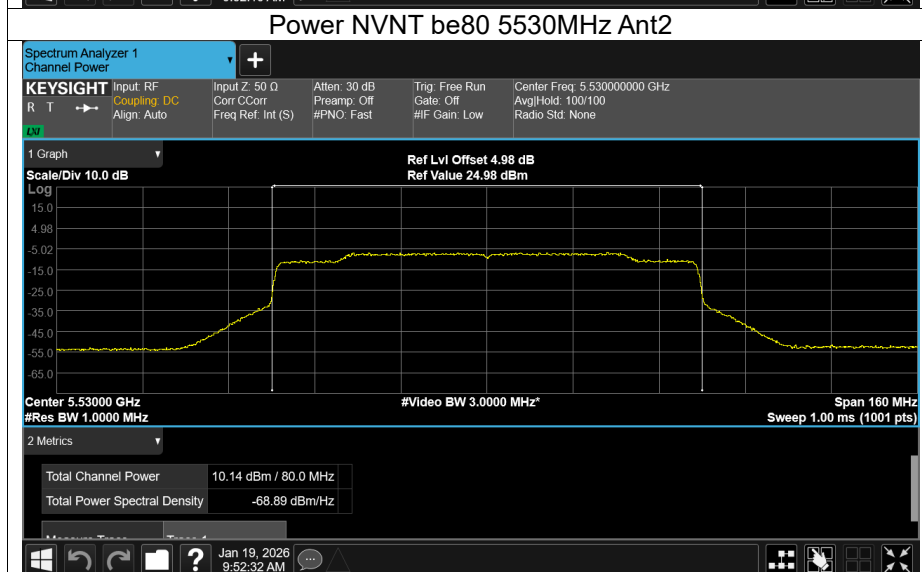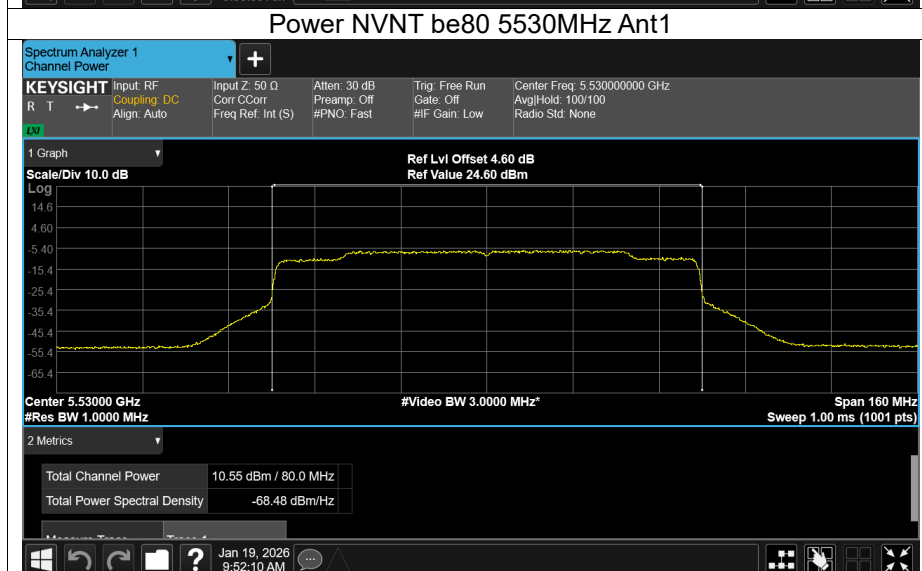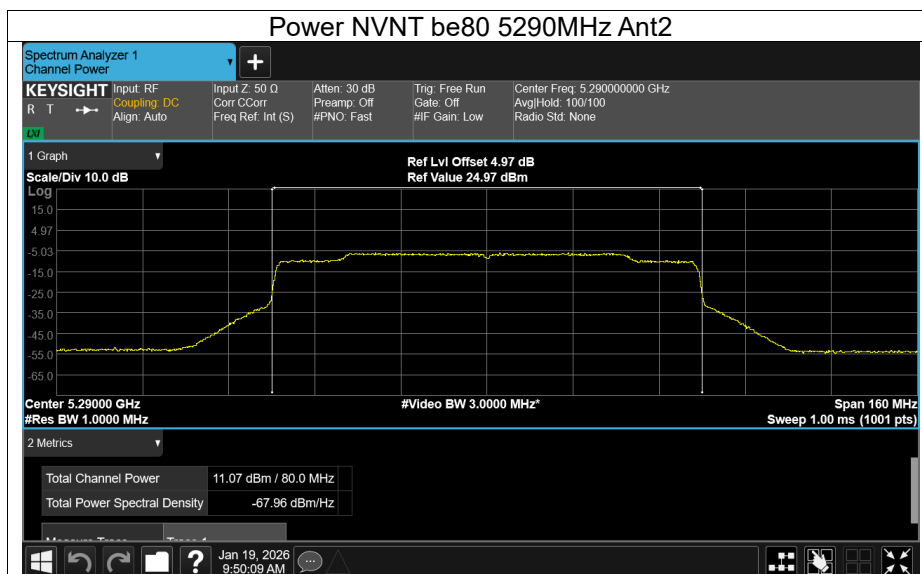

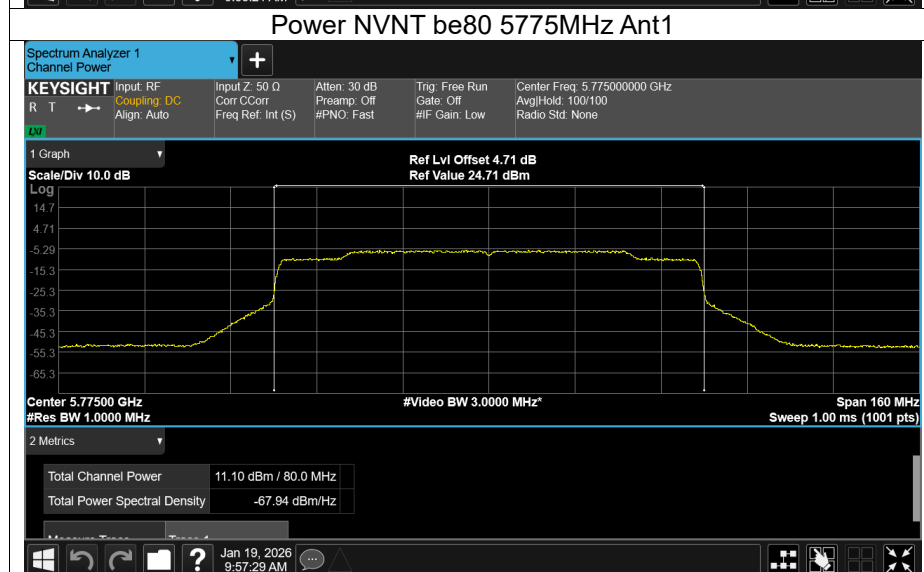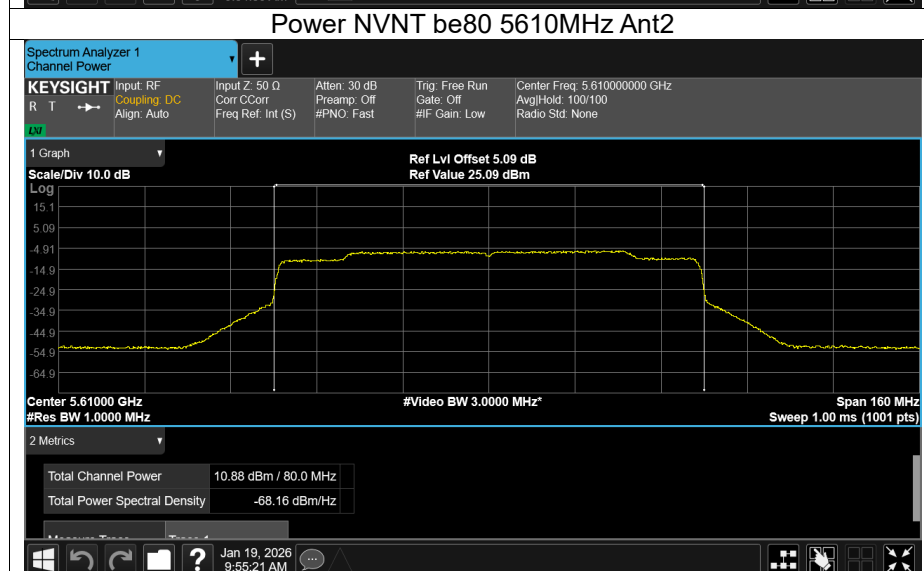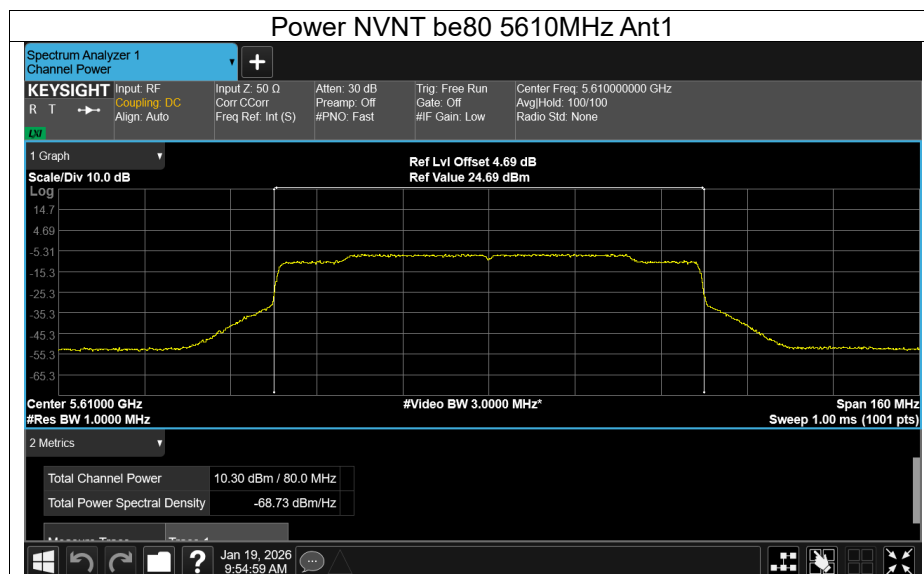

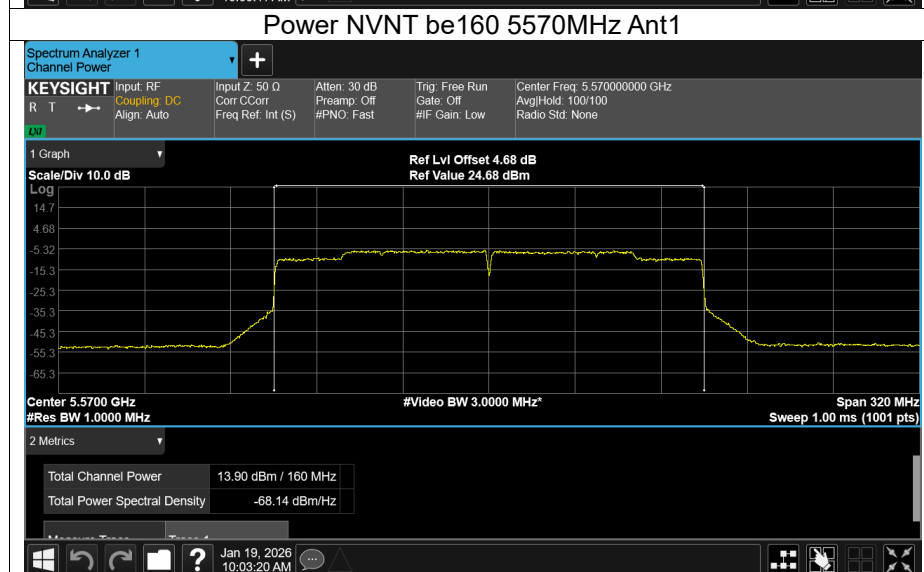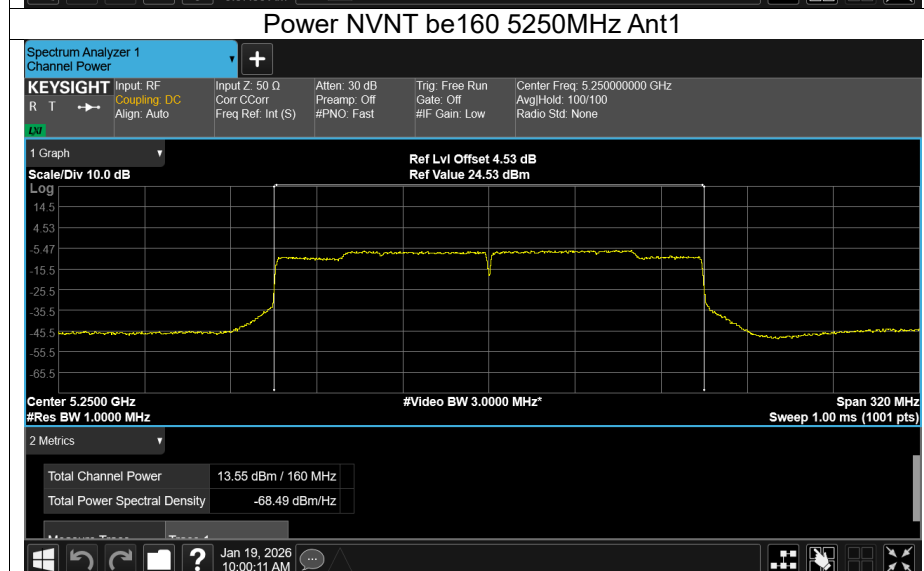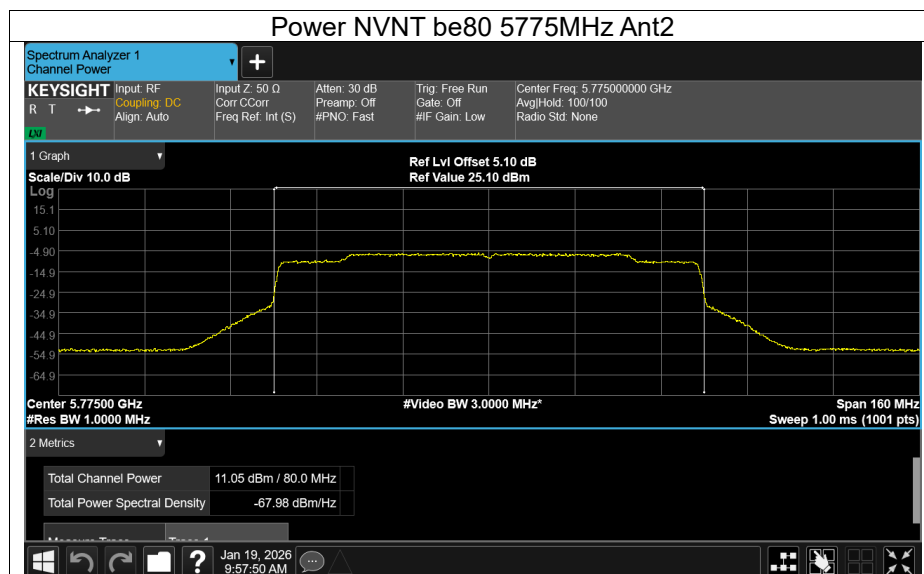

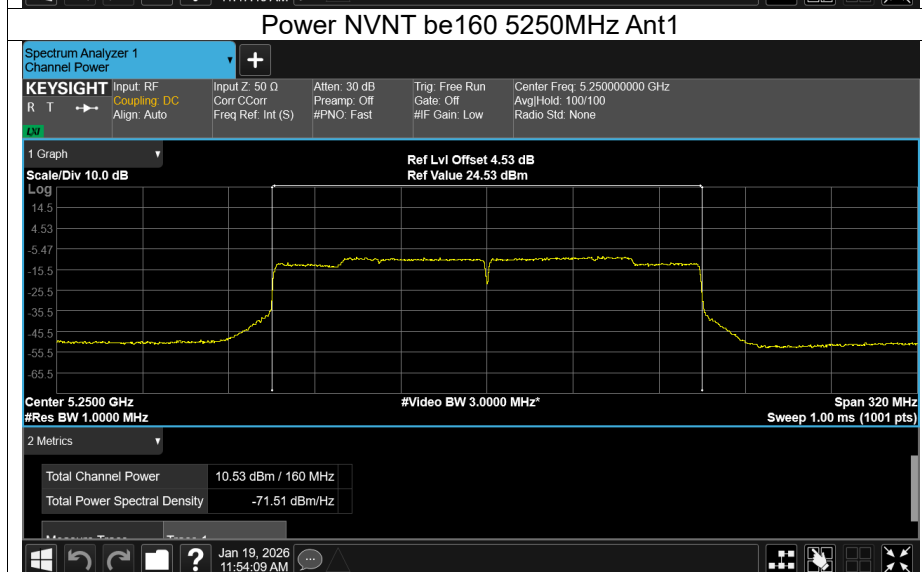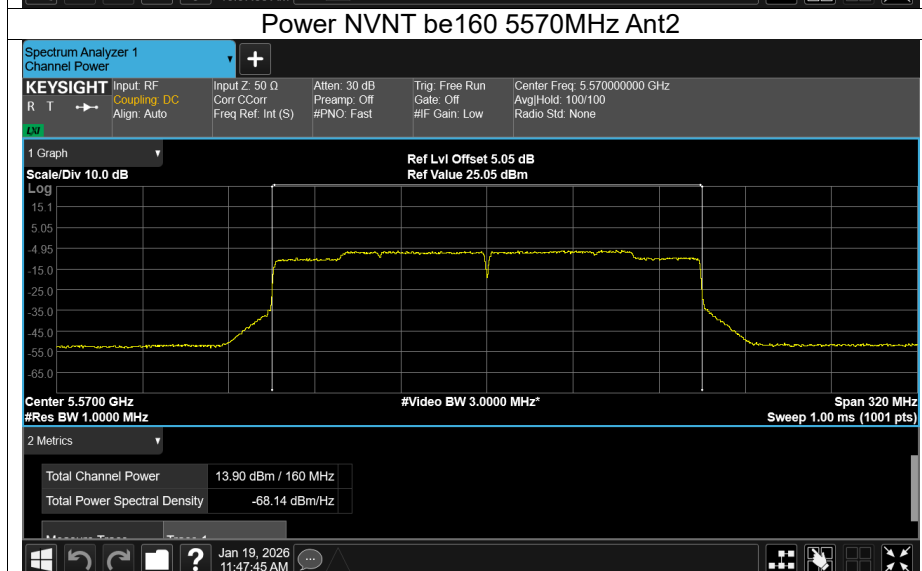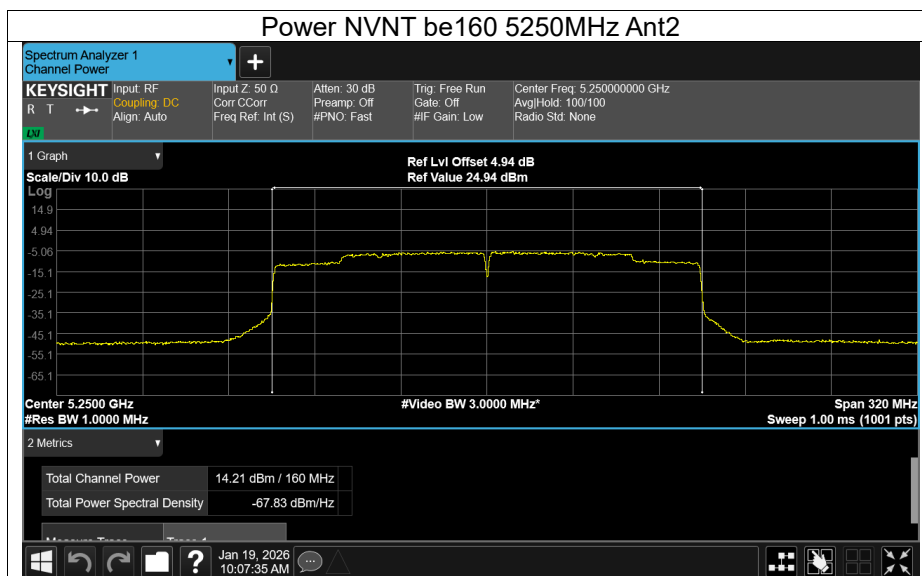

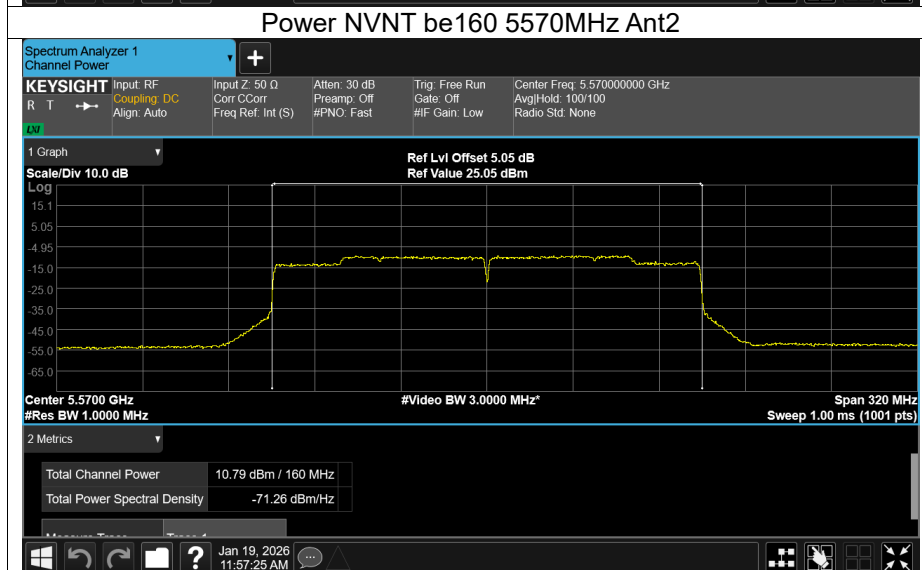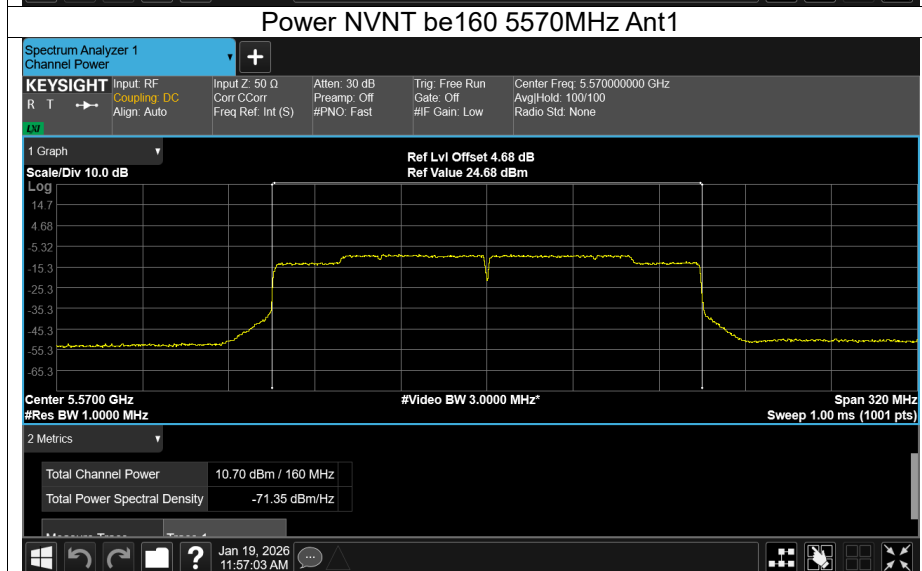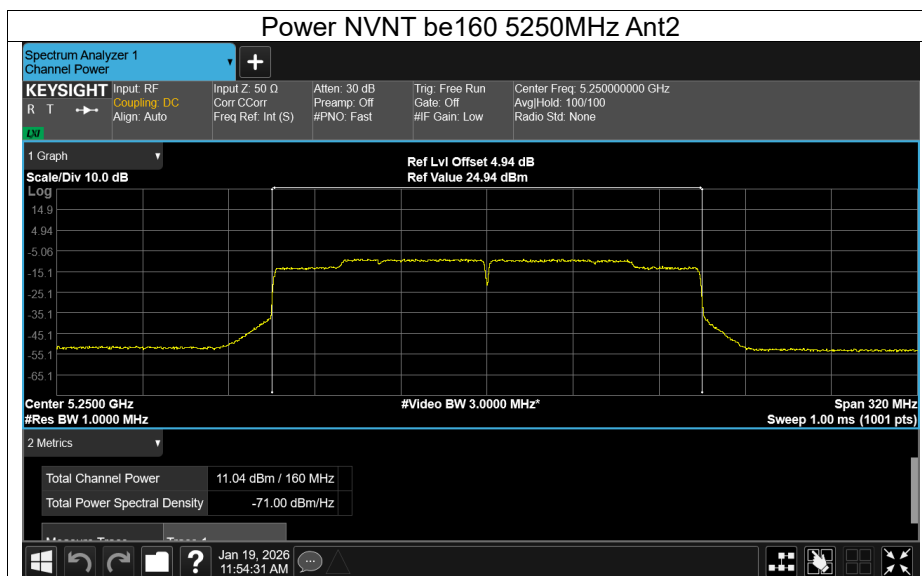



-26dB Bandwidth

Condition	Mode	Frequency (MHz)	Antenna	-26 dB Bandwidth (MHz)	Verdict
NVNT	a	5180	Ant1	23.708	Pass
NVNT	a	5200	Ant1	23.75	Pass
NVNT	a	5240	Ant1	24.071	Pass
NVNT	a	5260	Ant1	23.803	Pass
NVNT	a	5300	Ant1	23.353	Pass
NVNT	a	5320	Ant1	23.407	Pass
NVNT	a	5500	Ant1	22.848	Pass
NVNT	a	5580	Ant1	24.177	Pass
NVNT	a	5700	Ant1	23.435	Pass
NVNT	a	5180	Ant2	24.345	Pass
NVNT	a	5200	Ant2	23.967	Pass
NVNT	a	5240	Ant2	23.963	Pass
NVNT	a	5260	Ant2	23.242	Pass
NVNT	a	5300	Ant2	23.666	Pass
NVNT	a	5320	Ant2	23.603	Pass
NVNT	a	5500	Ant2	23.877	Pass
NVNT	a	5580	Ant2	23.635	Pass
NVNT	a	5700	Ant2	23.403	Pass
NVNT	n20	5180	Ant1	24.252	Pass
NVNT	n20	5200	Ant1	24.359	Pass
NVNT	n20	5240	Ant1	23.843	Pass
NVNT	n20	5260	Ant1	23.846	Pass
NVNT	n20	5300	Ant1	24.084	Pass
NVNT	n20	5320	Ant1	23.377	Pass
NVNT	n20	5500	Ant1	23.741	Pass
NVNT	n20	5580	Ant1	24.342	Pass
NVNT	n20	5700	Ant1	24.294	Pass
NVNT	n20	5180	Ant2	23.736	Pass
NVNT	n20	5200	Ant2	24.071	Pass
NVNT	n20	5240	Ant2	24.761	Pass
NVNT	n20	5260	Ant2	24.16	Pass
NVNT	n20	5300	Ant2	24.155	Pass
NVNT	n20	5320	Ant2	24.479	Pass
NVNT	n20	5500	Ant2	23.753	Pass
NVNT	n20	5580	Ant2	24.061	Pass
NVNT	n20	5700	Ant2	24.58	Pass
NVNT	n40	5190	Ant1	42.943	Pass
NVNT	n40	5230	Ant1	42.719	Pass
NVNT	n40	5270	Ant1	43.987	Pass
NVNT	n40	5310	Ant1	43.042	Pass
NVNT	n40	5510	Ant1	42.945	Pass
NVNT	n40	5550	Ant1	43.701	Pass
NVNT	n40	5670	Ant1	43.226	Pass
NVNT	n40	5190	Ant2	42.647	Pass
NVNT	n40	5230	Ant2	43.683	Pass
NVNT	n40	5270	Ant2	42.057	Pass
NVNT	n40	5310	Ant2	43.49	Pass
NVNT	n40	5510	Ant2	42.866	Pass
NVNT	n40	5550	Ant2	43.966	Pass
NVNT	n40	5670	Ant2	43.18	Pass
NVNT	ac20	5180	Ant1	24.364	Pass
NVNT	ac20	5200	Ant1	24.569	Pass
NVNT	ac20	5240	Ant1	24.355	Pass
NVNT	ac20	5260	Ant1	24.201	Pass
NVNT	ac20	5300	Ant1	24.369	Pass
NVNT	ac20	5320	Ant1	23.999	Pass
NVNT	ac20	5500	Ant1	23.76	Pass
NVNT	ac20	5580	Ant1	24.16	Pass



NVNT	ac20	5700	Ant1	24.151	Pass
NVNT	ac20	5180	Ant2	24.028	Pass
NVNT	ac20	5200	Ant2	24.254	Pass
NVNT	ac20	5240	Ant2	24.336	Pass
NVNT	ac20	5260	Ant2	24.23	Pass
NVNT	ac20	5300	Ant2	23.306	Pass
NVNT	ac20	5320	Ant2	24.456	Pass
NVNT	ac20	5500	Ant2	24.183	Pass
NVNT	ac20	5580	Ant2	24.143	Pass
NVNT	ac20	5700	Ant2	23.975	Pass
NVNT	ac40	5190	Ant1	42.684	Pass
NVNT	ac40	5230	Ant1	43.049	Pass
NVNT	ac40	5270	Ant1	43.38	Pass
NVNT	ac40	5310	Ant1	42.868	Pass
NVNT	ac40	5510	Ant1	42.956	Pass
NVNT	ac40	5550	Ant1	43.722	Pass
NVNT	ac40	5670	Ant1	43.254	Pass
NVNT	ac40	5190	Ant2	42.795	Pass
NVNT	ac40	5230	Ant2	42.507	Pass
NVNT	ac40	5270	Ant2	42.94	Pass
NVNT	ac40	5310	Ant2	42.607	Pass
NVNT	ac40	5510	Ant2	43.346	Pass
NVNT	ac40	5550	Ant2	42.628	Pass
NVNT	ac40	5670	Ant2	43.044	Pass
NVNT	ac80	5210	Ant1	84.692	Pass
NVNT	ac80	5290	Ant1	83.496	Pass
NVNT	ac80	5530	Ant1	83.727	Pass
NVNT	ac80	5610	Ant1	84.711	Pass
NVNT	ac80	5210	Ant2	83.891	Pass
NVNT	ac80	5290	Ant2	86.754	Pass
NVNT	ac80	5530	Ant2	84.432	Pass
NVNT	ac80	5610	Ant2	85.533	Pass
NVNT	ac160	5250	Ant1	166.637	Pass
NVNT	ac160	5570	Ant1	167.435	Pass
NVNT	ac160	5250	Ant2	167.343	Pass
NVNT	ac160	5570	Ant2	166.466	Pass
NVNT	ax20	5180	Ant1	23.337	Pass
NVNT	ax20	5200	Ant1	23.104	Pass
NVNT	ax20	5240	Ant1	22.751	Pass
NVNT	ax20	5260	Ant1	23.451	Pass
NVNT	ax20	5300	Ant1	22.864	Pass
NVNT	ax20	5320	Ant1	22.949	Pass
NVNT	ax20	5500	Ant1	24.035	Pass
NVNT	ax20	5580	Ant1	23.054	Pass
NVNT	ax20	5700	Ant1	22.442	Pass
NVNT	ax20	5180	Ant2	24.172	Pass
NVNT	ax20	5200	Ant2	23.306	Pass
NVNT	ax20	5240	Ant2	23.715	Pass
NVNT	ax20	5260	Ant2	23.067	Pass
NVNT	ax20	5300	Ant2	22.638	Pass
NVNT	ax20	5320	Ant2	24.671	Pass
NVNT	ax20	5500	Ant2	23.534	Pass
NVNT	ax20	5580	Ant2	23.762	Pass
NVNT	ax20	5700	Ant2	24.539	Pass
NVNT	ax40	5190	Ant1	41.168	Pass
NVNT	ax40	5230	Ant1	41.427	Pass
NVNT	ax40	5270	Ant1	42.589	Pass
NVNT	ax40	5310	Ant1	42.353	Pass
NVNT	ax40	5510	Ant1	42.236	Pass
NVNT	ax40	5550	Ant1	41.644	Pass
NVNT	ax40	5670	Ant1	42.087	Pass



NVNT	ax40	5190	Ant2	42.268	Pass
NVNT	ax40	5230	Ant2	42.917	Pass
NVNT	ax40	5270	Ant2	41.461	Pass
NVNT	ax40	5310	Ant2	43.372	Pass
NVNT	ax40	5510	Ant2	42.463	Pass
NVNT	ax40	5550	Ant2	42.628	Pass
NVNT	ax40	5670	Ant2	41.667	Pass
NVNT	ax80	5210	Ant1	85.304	Pass
NVNT	ax80	5290	Ant1	84.839	Pass
NVNT	ax80	5530	Ant1	84.028	Pass
NVNT	ax80	5610	Ant1	83.971	Pass
NVNT	ax80	5210	Ant2	85.553	Pass
NVNT	ax80	5290	Ant2	84.683	Pass
NVNT	ax80	5530	Ant2	83.813	Pass
NVNT	ax80	5610	Ant2	84.294	Pass
NVNT	ax160	5250	Ant1	167.55	Pass
NVNT	ax160	5570	Ant1	167.059	Pass
NVNT	ax160	5250	Ant2	167.485	Pass
NVNT	ax160	5570	Ant2	167.993	Pass
NVNT	be20	5180	Ant1	24.877	Pass
NVNT	be20	5200	Ant1	25.61	Pass
NVNT	be20	5240	Ant1	24.235	Pass
NVNT	be20	5260	Ant1	24.188	Pass
NVNT	be20	5300	Ant1	25.026	Pass
NVNT	be20	5320	Ant1	25.008	Pass
NVNT	be20	5500	Ant1	23.995	Pass
NVNT	be20	5580	Ant1	23.928	Pass
NVNT	be20	5700	Ant1	24.085	Pass
NVNT	be20	5180	Ant2	24.369	Pass
NVNT	be20	5200	Ant2	25.17	Pass
NVNT	be20	5240	Ant2	23.438	Pass
NVNT	be20	5260	Ant2	23.994	Pass
NVNT	be20	5300	Ant2	24.3	Pass
NVNT	be20	5320	Ant2	23.586	Pass
NVNT	be20	5500	Ant2	23.963	Pass
NVNT	be20	5580	Ant2	24.194	Pass
NVNT	be20	5700	Ant2	24.036	Pass
NVNT	be40	5190	Ant1	41.13	Pass
NVNT	be40	5230	Ant1	43.949	Pass
NVNT	be40	5270	Ant1	41.194	Pass
NVNT	be40	5310	Ant1	41.759	Pass
NVNT	be40	5510	Ant1	41.961	Pass
NVNT	be40	5550	Ant1	41.96	Pass
NVNT	be40	5670	Ant1	41.372	Pass
NVNT	be40	5190	Ant2	42.303	Pass
NVNT	be40	5230	Ant2	42.492	Pass
NVNT	be40	5270	Ant2	41.822	Pass
NVNT	be40	5310	Ant2	42.021	Pass
NVNT	be40	5510	Ant2	42.305	Pass
NVNT	be40	5550	Ant2	42.242	Pass
NVNT	be40	5670	Ant2	41.83	Pass
NVNT	be80	5210	Ant1	85.051	Pass
NVNT	be80	5290	Ant1	85.94	Pass
NVNT	be80	5530	Ant1	84.969	Pass
NVNT	be80	5610	Ant1	83.546	Pass
NVNT	be80	5210	Ant2	85.644	Pass
NVNT	be80	5290	Ant2	84.41	Pass
NVNT	be80	5530	Ant2	83.539	Pass
NVNT	be80	5610	Ant2	83.758	Pass
NVNT	be160	5250	Ant1	168.329	Pass
NVNT	be160	5570	Ant1	167.25	Pass



NVNT	be160	5250	Ant2	166.469	Pass
NVNT	be160	5570	Ant2	167.344	Pass



